

# **China Harbour Engineering Company Limited**

Contract No. HY/2010/02

# Hong Kong – Zhuhai – Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Works

Monthly EM&A Report for October 2012

[11/2012]

	Name	Signature
Prepared & Checked:	Y T Tang	Markey
Reviewed, Approved and Certified:	Echo Leong (ETL)	Shokeouf

Version:	Rev. 0	Date: 13 November2012	2

### Disclaimer

This report is prepared for China Harbour Engineering Company Limited and is given for its sole benefit in relation to and pursuant to Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities-Reclamation Works and may not be disclosed to, quoted to or relied upon by any person other than China Harbour Engineering Company Limited without our prior written consent. No person (other than China Harbour Engineering Company Limited) into whose possession a copy of this report comes may rely on this report without our express written consent and China Harbour Engineering Company Limited may not rely on it for any purpose other than as described above.

AECOM Asia Co. Ltd.

15/F, Grand Central Plaza, Tower 1, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com



Ref.: HYDHZMBEEM00\_0\_0491L.12

By Fax (2268 3970) and By Post

Engineer's Representative Ove Arup & Partners Level 5, Festival Walk 80 Tat Chee Avenue Kowloon Tong, Kowloon Hong Kong

Attention: Mr. Michael Lo

Dear Mr. Lo.

Re: Agreement No. CE 48/2011 (EP)
Environmental Project Office for the
HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing Facilities,
and Tuen Mun-Chek Lap Kok Link – Investigation

Contract No. HY/2010/02 Hong Kong – Zhuhai – Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work Monthly Environmental Monitoring & Audit Report for October 2012

Reference is made to the Environmental Team's submission of the Monthly Environmental Monitoring & Audit Report for October 2012 (letter ref. 60249820/C/RMKY12111201 dated 12 November 2012) copied to us by E-mail on 12 November 2012.

We are pleased to inform you that we have no adverse comment on the captioned Monthly EM&A Report. We write to verify the captioned report in accordance with Condition 5.4 of EP-353/2009/E and Condition 4.4 of EP-354/2009/A (for TM-CLKL Southern Landfall Reclamation only).

We would like to remind the Environmental Team (ET) Leader to manage the dolphin specialist team as part of the ET such that the quality of dolphin monitoring report will be improved.

Thank you very much for your kind attention and please do not hesitate to contact the undersigned should you have any queries.

Yours sincerely.

Raymond Dai

Independent Environmental Checker

c.c. HyD Mr. Matthew Fung (By Fax: 3188 6614)
HyD Mr. Philip Lam (By Fax: 3188 6614)
AECOM Ms. Echo Leong (By Fax: 2317 7609)
CHEC Mr. C M Wong (By Fax: 2578 0413)

Q:\Projects\HYDHZMBEEM00\Corr\HYDHZMBEEM00\_0\_0491L.12.doc

# TABLE OF CONTENTS

			Pag
EXI	ECUTIVE	SUMMARY	1
1	INTRO	DUCTION	3
	1.1 1.2 1.3 1.4 1.5	Background Scope of Report Project Organization Summary of Construction Works Summary of EM&A Programme Requirements	3 3 4 4 5
2	AIR QL	JALITY MONITORING	6
	2.1 2.2 2.3 2.4 2.5 2.6 2.7	Monitoring Requirements Monitoring Equipment Monitoring Locations Monitoring Parameters, Frequency and Duration Monitoring Methodology Monitoring Schedule for the Reporting Month Results and Observations	6 6 7 7 9
3	NOISE	MONITORING	10
	3.1 3.2 3.3 3.4 3.5 3.6 3.7	Monitoring Requirements Monitoring Equipment Monitoring Locations Monitoring Parameters, Frequency and Duration Monitoring Methodology Monitoring Schedule for the Reporting Month Monitoring Results	10 10 10 10 11 11
4	WATER	R QUALITY MONITORING	13
	4.1 4.2 4.3 4.4 4.5 4.6 4.7	Monitoring Requirements Monitoring Equipment Monitoring Parameters, Frequency and Duration Monitoring Locations Monitoring Methodology Monitoring Schedule for the Reporting Month Results and Observations	13 13 13 14 15 16
5	DOLPH	IIN MONITORING	19
	5.1 5.2 5.3 5.4 5.5 5.6 5.7	Monitoring Requirements Monitoring Equipment Monitoring Frequency and Conditions Monitoring Methodology and Location Monitoring Procedures Monitoring Schedule for the Reporting Month Results and Observations	19 19 19 19 21 21
6	ENVIR	ONMENTAL SITE INSPECTION AND AUDIT	23
	6.1 6.2 6.3 6.4 6.5 6.6	Site Inspection Advice on the Solid and Liquid Waste Management Status Environmental Licenses and Permits Implementation Status of Environmental Mitigation Measures Summary of Exceedances of the Environmental Quality Performance Limit Summary of Complaints, Notification of Summons and Successful Prosecutions	23 24 25 26 26
7	FUTUR	RE KEY ISSUES	27
	7.1 7.2 7.3	Construction Programme for the Coming Months Key Issues for the Coming Month Monitoring Schedule for the Coming Month	27 27 27

8	CONCL	USIONS AND RECOMMENDATIONS	28
	8.1	Conclusions	28
	8.2	Recommendations	28

### **List of Tables**

Table 1.1	Contact Information of Key Personnel
Table 2.1	Air Quality Monitoring Equipment
Table 2.2	Locations of Impact Air Quality Monitoring Stations
Table 2.3	Air Quality Monitoring Parameters, Frequency and Duration
Table 2.4	Summary of 1-hour TSP Monitoring Results in the Reporting Period
Table 2.5	Summary of 24-hour TSP Monitoring Results in the Reporting Period
Table 3.1	Noise Monitoring Equipment
Table 3.2	Locations of Impact Noise Monitoring Stations
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 3.4	Summary of Construction Noise Monitoring Results in the Reporting Period
Table 4.1	Water Quality Monitoring Equipment
Table 4.2	Impact Water Quality Monitoring Parameters and Frequency
Table 4.3	Impact Water Quality Monitoring Stations
Table 4.4	Laboratory Analysis for Suspended Solids
Table 5.1	Dolphin Monitoring Equipment
Table 5.2	Impact Dolphin Monitoring Line Transect Co-ordinates (Provided by AFCD)
Table 5.3	Impact Dolphin Monitoring Survey Effort Summary
Table 5.4	Impact Dolphin Monitoring Survey Details in October 2012
Table 6.1	Summary of Environmental Licensing and Permit Status

# **Figures**

Figure 1	General Project Layout Plan
Figure 2	Impact Air Quality and Noise Monitoring Stations and Wind Station
Figure 3	Impact Water Quality Monitoring Stations
Figure 4	Impact Dolphin Monitoring Line Transect Layout Map
Figure 5	Impact Dolphin Monitoring Survey Efforts and Sightings in October 2012
Figure 6	Environmental Complaint Handling Procedure

Project Organization for Environmental Works

# **List of Appendices**

Appendix A

Appendix B	Three Month Rolling Construction Programmes
Appendix C	Implementation Schedule of Environmental Mitigation Measures (EMIS)
Appendix D	Summary of Action and Limit Levels
Appendix E	Calibration Certificates of Monitoring Equipments
Appendix F	EM&A Monitoring Schedules
Appendix G	Impact Air Quality Monitoring Results and their Graphical Presentation
Appendix H	Meteorological Data for Monitoring Periods on Monitoring Dates in October 2012
Appendix I	Impact Construction Noise Monitoring Results and their Graphical Presentation
Appendix J	Impact Water Quality Monitoring Results and their Graphical Presentation
Appendix K	Impact Dolphin Monitoring Survey Sighting Summary
Appendix L	Event Action Plan
Appendix M	Monthly Summary of Waste Flow Table
Appendix N	Cumulative Statistics on Exceedances, Complaints, Notifications of Summons and Successful
	Prosecutions

# **EXECUTIVE SUMMARY**

Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as "the Project") mainly comprises reclamation at the northeast of the Hong Kong International Airport of an area of about 130-hectare for the construction of an artificial island for the development of the Hong Kong Boundary Crossing Facilities (HKBCF), and about 19-hectare for the southern landfall of the Tuen Mun - Chek Lap Kok Link (TMCLKL). It is a designated project and is governed by the current permits for the Project, i.e. the amended Environmental Permits (EPs) issued on 16 Oct 2012 (EP-353/2009/E) and 8 December 2011 (EP-354/2009/A) (for TMCLKL Southern Landfall Reclamation only).

Ove Arup & Partners Hong Kong Limited (Arup) was appointed by Highways Department (HyD) as the consultants for the design and construction assignment for the Project's reclamation works (i.e. the Engineer for the Project).

China Harbour Engineering Company Limited (CHEC) was awarded by HyD as the Contractor to undertake the construction work of the Project.

ENVIRON Hong Kong Ltd. was employed by HyD as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) for the Project.

AECOM Asia Co. Ltd. (AECOM) was appointed by CHEC to undertake the role of Environmental Team for the Project for carrying out the environmental monitoring and audit (EM&A) works.

The construction phase of the Project under the EPs was commenced on 12 March 2012 and will be tentatively completed by early Year 2016. The EM&A programme, including air quality, noise, water quality and dolphin monitoring and environmental site inspections, was commenced on 12 March 2012.

This report documents the findings of EM&A works conducted in the period between 1 and 31 October 2012. As informed by the Contractor, major activities in the reporting period were:-

#### Marine-based Works

- Maintenance of Silt curtain
- Stone column installation
- Construction of cellular structure
- Backfill cellular structure
- Band drain installation trial

# Land-based Works

- Site office erection and construction at site area WA2
- Sign board erection at entrance of area WA2
- Hoarding erection at Work Areas Portion D and WA2
- Maintenance works of Public Works Regional Laboratory at site area WA3
- Geotextile fabrication at Works Area WA2
- Stone column and cellular wall installation barges setup and their maintenance works at Works Area WA4

A summary of monitoring and audit activities conducted in the reporting period is listed below:

24-hour Total Suspended Particulates (TSP) monitoring5 sessions1-hour TSP monitoring5 sessionsNoise monitoring4 sessionsImpact water quality monitoring14 sessionsImpact dolphin monitoring2 surveysJoint Environmental site inspection4 sessions

#### **Breaches of Action and Limit Levels for Air Quality**

No Action/Limit Level exceedance of 1-hour TSP and 24-hour TSP results was recorded in the reporting month.

#### **Breaches of Action and Limit Levels for Noise**

No Action/Limit Level exceedance of construction noise was recorded in the reporting month.

#### **Breaches of Action and Limit Levels for Water Quality**

One (1) Action Level exceedance and one (1) Limit Level Exceedance were recorded at measured turbidity (in NTU) and at measured suspended solid (mg/L) respectively in the reporting month. Investigation results show that the exceedances were not due to the Project works.

#### **Impact Dolphin Monitoring**

A total of fifteen dolphin sightings were recorded during the two surveys, one on the 11 October 2012, seven on the 12 October 2012, three on the 23 October 2012 and four on the 24 October 2012. Of the fifteen sightings, nine were "on effort" (which are all under favourable condition) and six were "opportunistic". A total of forty seven individuals were sighted from the two impact dolphin surveys in the reporting period.

Behaviour: five groups were feeding but only two of these groups were associated with a fishing vessel (hang trawler); five groups were recorded as travelling; two groups were associated with multiple behaviour (feeding and surface active); one group was recorded as surface active and the behaviour of two groups were noted as unknown.

#### Complaint, Notification of Summons and Successful Prosecution

One (1) environmental complaint was received in the reporting month. Investigation results show that the complaint was not project-related.

No notification of summons and successful prosecution was received in the reporting month.

## **Reporting Change**

There was no reporting change required in the reporting period.

#### **Future Key Issues**

Key issues to be considered in the coming month included:-

- Site runoff should be properly collected and treated prior to discharge;
- Minimize loss of sediment from filling works;
- Regular review and maintenance of silt curtain systems, drainage systems and desilting facilities;
- Exposed surfaces/soil stockpiles should be properly treated to avoid generation of silty surface run-off during rainstorm:
- Regular review and maintenance of wheel washing facilities provided at all site entrances/exits;
- Conduct regular inspection of various working machineries and vessels within works areas to avoid any dark smoke emission;
- Suppress dust generated from work processes with use of bagged cements, earth movements, excavation activities, exposed surfaces/soil stockpiles and haul road traffic;
- Quieter powered mechanical equipment should be used;
- Provision of proper and effective noise control measures for operating equipment and machinery on-site, such as erection of movable noise barriers or enclosure for noisy plants;
- Closely check and replace the sound insulation materials regularly;
- Better scheduling of construction works to minimize noise nuisance;
- Properly store and label oil drums and chemical containers placed on site;
- Proper chemicals, chemical wastes and wastes management;
- Maintenance works should be carried out within roofed, paved and confined areas;
- Collection and segregation of construction waste and general refuse on land and in the sea should be carried out properly and regularly; and
- Proper protection and regular inspection of existing trees, transplanted/retained trees.



### 1 INTRODUCTION

# 1.1 Background

- 1.1.1 Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities Reclamation Work (here below, known as "the Project") mainly comprises reclamation at the northeast of the Hong Kong International Airport of an area of about 130-hectare for the construction of an artificial island for the development of the Hong Kong Boundary Crossing Facilities (HKBCF), and about 19-hectare for the southern landfall of the Tuen Mun Chek Lap Kok Link (TMCLKL).
- 1.1.2 The environmental impact assessment (EIA) reports (Hong Kong Zhuhai Macao Bridge Hong Kong Boundary Crossing Facilities EIA Report (Register No. AEIAR-145/2009) (HKBCFEIA) and Tuen Mun Chek Lap Kok Link EIA Report (Register No. AEIAR-146/2009) (TMCLKLEIA), and their environmental monitoring and audit (EM&A) Manuals (original EM&A Manuals), for the Project were approved by Environmental Protection Department (EPD) in October 2009.
- 1.1.3 EPD subsequently issued the Environmental Permit (EP) for HKBCF in November 2009 (EP-353/2009) and the Variation of Environmental Permit (VEP) in June 2010 (EP-353/2009/A), November 2010 (EP-353/2009/B), November 2011 (EP-353/2009/C), March 2012 (EP-353/2009/D) and October 2012 (EP-353/2009/E). Similarly, EPD issued the Environmental Permit (EP) for TMCLKL in November 2009 (EP-354/2009) and the Variation of Environmental Permit (VEP) in December 2010 (EP-354/2009/A).
- 1.1.4 The Project is a designated project and is governed by the current permits for the Project, i.e. the amended EPs issued on 16 October 2012 (EP-353/2009/E) and 8 December 2011 (EP-354/2009/A) (for TMCLKL Southern Landfall Reclamation only).
- 1.1.5 A Project Specific EM&A Manual, which included all project-relation contents from the original EM&A Manuals for the Project, was issued in May 2012.
- 1.1.6 Ove Arup & Partners Hong Kong Limited (Arup) was appointed by Highways Department (HyD) as the consultants for the design and construction assignment for the Project's reclamation works (i.e. the Engineer for the Project).
- 1.1.7 China Harbour Engineering Company Limited (CHEC) was awarded by HyD as the Contractor to undertake the construction work of the Project.
- 1.1.8 ENVIRON Hong Kong Ltd. was employed by HyD as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) for the Project.
- 1.1.9 AECOM Asia Co. Ltd. (AECOM) was appointed by CHEC to undertake the role of Environmental Team for the Project for carrying out the EM&A works.
- 1.1.10 The construction phase of the Project under the EPs was commenced on 12 March 2012 and will be tentatively completed by early Year 2016.
- 1.1.11 According to the Project Specific EM&A Manual, there is a need of an EM&A programme including air quality, noise, water quality and dolphin monitoring and environmental site inspections. The EM&A programme of the Project commenced on 12 March 2012.

#### 1.2 Scope of Report

1.2.1 This is the eighth monthly EM&A Report under the Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Works. This report presents a summary of the environmental monitoring and audit works, list of activities and mitigation measures proposed by the ET for the Project in October 2012.

# 1.3 Project Organization

1.3.1 The project organization structure is shown in Appendix A. The key personnel contact names and numbers are summarized in Table 1.1.

Table 1.1 Contact Information of Key Personnel

Party	Position	Name	Telephone	Fax
Engineer's Representative (ER)	01115		0-00	
(Ove Arup & Partners Hong Kong Limited)	Chief Resident Engineer	Michael Lo	2528 3031	2668 3970
IEC / ENPO	Independent Environmental Checker	Raymond Dai	3743 0788	3548 6988
(ENVIRON Hong Kong Limited)	Environmental Project Office Leader	Y. H. Hui	3743 0788	3548 6988
	General Manager (S&E)	Daniel Leung	3157 1086	2578 0413
Contractor  (China Harbour Engineering Company Limited)	Environmental Officer	C. M. Wong	3157 1086	2578 0413
Company Limited)	24-hour Hotline	Alan C.C. Yeung	9448 0325	
ET  (AECOM Asia  Company Limited)	ET Leader	Echo Leong	3922 9280	2317 7609

# 1.4 Summary of Construction Works

- 1.4.1 The construction phase of the Project under the EP commenced on 12 March 2012.
- 1.4.2 As informed by the Contractor, details of the major works carried out in this reporting period are listed below:-

#### Marine-based Works

- Maintenance of Silt curtain
- Stone column installation
- Construction of cellular structure
- Backfill cellular structure
- Band drain installation trial

# Land-based Works

- Site office erection and construction at Works Area WA2
- Sign board erection at entrance of Works Area WA2
- Hoarding erection at Work Areas Portion D and WA2
- Maintenance works of Public Works Regional Laboratory at Works Area WA3
- Geotextile fabrication at Works Area WA2
- Stone column and cellular wall installation barges setup and their maintenance works at Works Area WA4

- 1.4.3 The 3-month rolling construction programme of the Project is shown in Appendix B.
- 1.4.4 The general layout plan of the Project site showing the detailed works areas is shown in Figure 1.
- 1.4.5 The environmental mitigation measures implementation schedule are presented in Appendix C.

# 1.5 Summary of EM&A Programme Requirements

- 1.5.1 The EM&A programme required environmental monitoring for air quality, noise, water quality, marine ecology and environmental site inspections for air quality, noise, water quality, waste management, marine ecology, and landscape and visual impact. The EM&A requirements for each parameter described in the following sections include:-
  - All monitoring parameters:
  - Monitoring schedules for the reporting month and forthcoming month;
  - Action and Limit levels for all environmental parameters;
  - Event / Action Plan;
  - Environmental mitigation measures, as recommended in the Project EIA reports; and
  - Environmental requirement in contract documents.

### 2 AIR QUALITY MONITORING

# 2.1 Monitoring Requirements

2.1.1 In accordance with the Project Specific EM&A Manual, baseline 1-hour and 24-hour Total Suspended Particulates (TSP) levels at 4 air quality monitoring stations were established. Impact 1-hour TSP monitoring was conducted for at least three times every 6 days, while impact 24-hour TSP monitoring was carried out for at least once every 6 days. The Action and Limit level of the air quality monitoring is provided in Appendix D.

#### 2.2 Monitoring Equipment

2.2.1 24-hour TSP air quality monitoring was performed using High Volume Sampler (HVS) located at each designated monitoring station. The HVS meets all the requirements of the Project Specific EM&A Manual. Portable direct reading dust meters were used to carry out the 1-hour TSP monitoring. Brand and model of the equipment is given in Table 2.1.

Table 2.1 Air Quality Monitoring Equipment

Equipment	Brand and Model
Portable direct reading dust meter (1-hour TSP)	Sibata Digital Dust Monitor (Model No. LD-3 and LD-3B)
High Volume Sampler (24-hour TSP)	Tisch Environmental Mass Flow Controlled Total Suspended Particulate (TSP) High Volume Air Sampler (Model No. TE-5170)

### 2.3 Monitoring Locations

- 2.3.1 Monitoring locations AMS2 and AMS7 were set up at the proposed locations in accordance with Project Specific EM&A Manual. For AMS6 (Dragonair/CNAC (Group) Building), permission on setting up and carrying out impact monitoring works was sought, however, access to the premise has not been granted yet on this report issuing date. For monitoring location AMS3 (Ho Yu College), as proposed in the Project Specific EM&A Manual, approval for carrying out impact monitoring could not be obtained from the principal of the school. Permission on setting up and carrying out impact monitoring works at nearby sensitive receivers, like Caribbean Coast and Coastal Skyline, was also sought. However, approvals for carrying out impact monitoring works within their premises were not obtained. Impact air quality monitoring was conducted at site boundary of the site office area in Works Area WA2 (AMS3A) respectively. Same baseline and Action Level for air quality, as derived from the baseline monitoring data recorded at Ho Yu College, was adopted for this alternative air quality location.
- 2.3.2 Figure 2 shows the locations of monitoring stations. Table 2.2 describes the details of the monitoring stations.

**Table 2.2 Locations of Impact Air Quality Monitoring Stations** 

Monitoring Station Location		Description	
AMS2	Tung Chung AMS2 Development Pier Rooftop of the		
AMS3A	Site Boundary of Site Office Area at Works Area WA2	On ground at the area boundary	
AMS6* Dragonair/CNAC (Group) Building		On ground at boundary of the premise	
AMS7	Hong Kong SkyCity Marriott Hotel	On ground at boundary of the premise	

<sup>\*</sup>Remark: Permission on setting up and carrying out impact monitoring works was sought, however, access to the premise has not been granted yet on this report issuing date.

# 2.4 Monitoring Parameters, Frequency and Duration

2.4.1 Table 2.3 summarizes the monitoring parameters, frequency and duration of impact TSP monitoring.

Table 2.3 Air Quality Monitoring Parameters, Frequency and Duration

Parameter	Frequency and Duration		
1-hour TSP	Three times every 6 days while the highest dust impact was expected		
24-hour TSP Once every 6 days			

# 2.5 Monitoring Methodology

#### 2.5.1 24-hour TSP Monitoring

- (a) The HVS was installed in the vicinity of the air sensitive receivers. The following criteria were considered in the installation of the HVS.
  - (i) A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
  - (ii) No two samplers should be placed less than 2 meters apart.
  - (iii) The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
  - (iv) A minimum of 2 meters separation from walls, parapets and penthouse for rooftop sampler.
  - (v) A minimum of 2 meters separation from any supporting structure, measured horizontally is required.
  - (vi) No furnace or incinerator flues nearby.
  - (vii) Airflow around the sampler was unrestricted.
  - (viii) Permission was obtained to set up the samplers and access to the monitoring stations.
  - (ix) A secured supply of electricity was obtained to operate the samplers.
  - (x) The sampler was located more than 20 meters from any dripline.
  - (xi) Any wire fence and gate, required to protect the sampler, did not obstruct the monitoring process.
  - (xii) Flow control accuracy was kept within ±2.5% deviation over 24-hour sampling period.

#### (b) Preparation of Filter Papers

- (i) Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
- (ii) All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not



variable by more than ±3 °C; the relative humidity (RH) was < 50% and not variable by more than ±5%. A convenient working RH was 40%.

(iii) All filter papers were prepared and analysed by ALS Technichem (HK) Pty Ltd., which is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes.

#### (c) Field Monitoring

- (i) The power supply was checked to ensure the HVS works properly.
- (ii) The filter holder and the area surrounding the filter were cleaned.
- (iii) The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- (iv) The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- (v) The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied was sufficient to avoid air leakage at the edges.
- (vi) Then the shelter lid was closed and was secured with the aluminum strip.
- (vii) The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.
- (viii) A new flow rate record sheet was set into the flow recorder.
- On site temperature and atmospheric pressure readings were taken and the flow rate of the HVS was checked and adjusted at around 1.1 m<sup>3</sup>/min, and complied with the range specified in the updated EM&A Manual (i.e. 0.6-1.7 m<sup>3</sup>/min).
- (x) The programmable digital timer was set for a sampling period of 24 hrs, and the starting time, weather condition and the filter number were recorded.
- (xi) The initial elapsed time was recorded.
- (xii) At the end of sampling, on site temperature and atmospheric pressure readings were taken and the final flow rate of the HVS was checked and recorded.
- (xiii) The final elapsed time was recorded.
- (xiv) The sampled filter was removed carefully and folded in half length so that only surfaces with collected particulate matter were in contact.
- (xv) It was then placed in a clean plastic envelope and sealed.
- (xvi) All monitoring information was recorded on a standard data sheet.
- (xvii) Filters were then sent to ALS Technichem (HK) Pty Ltd. for analysis.

# (d) Maintenance and Calibration

- (i) The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- (ii) 5-point calibration of the HVS was conducted using TE-5025A Calibration Kit prior to the commencement of baseline monitoring. Bi-monthly 5-point calibration of the HVS will be carried out during impact monitoring.
- (iii) Calibration certificate of the HVSs are provided in Appendix E.

#### 2.5.2 1-hour TSP Monitoring

#### (a) Measuring Procedures

The measuring procedures of the 1-hour dust meter were in accordance with the Manufacturer's Instruction Manual as follows:-

- (i) Turn the power on.
- (ii) Close the air collecting opening cover.
- (iii) Push the "TIME SETTING" switch to [BG].
- (iv) Push "START/STOP" switch to perform background measurement for 6 seconds.
- (v) Turn the knob at SENSI ADJ position to insert the light scattering plate.
- (vi) Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
- (vii) Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- (viii) Pull out the knob and return it to MEASURE position.
- (ix) Push the "TIME SETTING" switch the time set in the display to 3 hours.



- (x) Lower down the air collection opening cover.
- (xi) Push "START/STOP" switch to start measurement.

## (b) Maintenance and Calibration

- (i) The 1-hour TSP meter was calibrated at 1-year intervals against a continuous particulate TEOM Monitor, Series 1400ab. Calibration certificates of the Laser Dust Monitors are provided in Appendix E.
- (ii) 1-hour validation checking of the TSP meter against HVS is carried out on half-year basis at the air quality monitoring locations.

# 2.6 Monitoring Schedule for the Reporting Month

2.6.1 The schedule for air quality monitoring in October 2012 is provided in Appendix F.

#### 2.7 Results and Observations

2.7.1 The monitoring results for 1-hour TSP and 24-hour TSP are summarized in Table 2.4 and 2.5 respectively. Detailed impact air quality monitoring results are presented in Appendix G.

Table 2.4 Summary of 1-hour TSP Monitoring Results in the Reporting Period

	Average (μg/m³)	Range (μg/m³)	Action Level (μg/m³)	Limit Level (μg/m³)
AMS2	81	76 – 86	374	500
AMS3A	83	78 – 87	368	500
AMS7	79	75 - 85	370	500

Table 2.5 Summary of 24-hour TSP Monitoring Results in the Reporting Period

	Average (μg/m³)	Range (μg/m³)	Action Level (μg/m³)	Limit Level (μg/m³)
AMS2	91	39 – 120	176	260
AMS3A	121	100 – 143	167	260
AMS7	88	33 – 125	183	260

- 2.7.2 The major dust source in the reporting period included construction activities from the Project, construction activities by other contacts, as well as nearby traffic emissions.
- 2.7.3 All 1-hour TSP and 24-hour TSP results were below the Action and Limit Level at all monitoring locations in the reporting month.
- 2.7.4 The event action plan is annexed in Appendix L.
- 2.7.5 Meteorological information collected from the wind station during the monitoring periods on the monitoring dates, as shown in Figure 2, including wind speed and wind direction, is annexed in Appendix H.

### 3 NOISE MONITORING

# 3.1 Monitoring Requirements

3.1.1 In accordance with the Project Specific EM&A Manual, impact noise monitoring was conducted for at least once per week during the construction phase of the Project. The Action and Limit level of the noise monitoring is provided in Appendix D.

#### 3.2 Monitoring Equipment

3.2.1 Noise monitoring was performed using sound level meter at each designated monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Brand and model of the equipment is given in Table 3.1.

Table 3.1 Noise Monitoring Equipment

Equipment	Brand and Model
Integrated Sound Level Meter	Rion NL-31
Acoustic Calibrator	Rion NC-73

# 3.3 Monitoring Locations

- 3.3.1 Monitoring locations NMS2 was set up at the proposed locations in accordance with Project Specific EM&A Manual. However, for monitoring location NMS3 (Ho Yu College), as proposed in the Project Specific EM&A Manual, approval for carrying out impact monitoring could not be obtained from the principal of the school. Permission on setting up and carrying out impact monitoring works at nearby sensitive receivers, like Caribbean Coast and Coastal Skyline, was also sought. However, approvals for carrying out impact monitoring works within their premises were not obtained. Impact noise monitoring was conducted at site boundary of the site office area in Works Area WA2 (NMS3A) respectively. Same baseline noise level (as derived from the baseline monitoring data recorded at Ho Yu College) and Limit Level were adopted for this alternative noise monitoring location.
- 3.3.2 Figure 2 shows the locations of the monitoring stations. Table 3.2 describes the details of the monitoring stations.

Table 3.2 Locations of Impact Noise Monitoring Stations

Monitoring Station	Location	Description
NMS2	Seaview Crescent Tower 1	Free-field on the rooftop of the premise
NMS3A	Site Boundary of Site Office Area at Works Area WA2	Free-field on ground at the area boundary.

# 3.4 Monitoring Parameters, Frequency and Duration

3.4.1 Table 3.3 summarizes the monitoring parameters, frequency and duration of impact noise monitoring.



Table 3.3 Noise Monitoring Parameters, Frequency and Duration

Parameter	Frequency and Duration
30-mins measurement at each monitoring station between 0700 and 1900 on normal weekdays (Monday to Saturday). $L_{eq}$ , $L_{10}$ and $L_{90}$ would be recorded.	At least once per week

# 3.5 Monitoring Methodology

#### 3.5.1 Monitoring Procedure

- (a) The sound level meter was set on a tripod at a height of 1.2 m above the ground for free-field measurements at NMS2. A correction of +3 dB(A) shall be made to the free field measurements.
- (b) All measurement at NMS3A were free field measurements in the reporting month at NMS3A. A correction of +3 dB(A) shall be made to the free field measurements.
- (c) The battery condition was checked to ensure the correct functioning of the meter.
- (d) Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:-
  - (i) frequency weighting: A
  - (ii) time weighting: Fast
  - (iii) time measurement:  $L_{eq(30\text{-minutes})}$  during non-restricted hours i.e. 07:00 1900 on normal weekdays.
- (e) Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator for 94dB(A) at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- (f) During the monitoring period, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- (g) Noise measurement was paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- (h) Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.

#### 3.5.2 Maintenance and Calibration

- (a) The microphone head of the sound level meter was cleaned with soft cloth at regular intervals.
- (b) The meter and calibrator were sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- (c) Calibration certificates of the sound level meters and acoustic calibrators are provided in Appendix E.

#### 3.6 Monitoring Schedule for the Reporting Month

3.6.1 The schedule for construction noise monitoring in October 2012 is provided in Appendix F.

# 3.7 Monitoring Results

3.7.1 The monitoring results for construction noise are summarized in Table 3.4 and the monitoring data is provided in Appendix I.



Table 3.4 Summary of Construction Noise Monitoring Results in the Reporting Period

	Average, dB(A),	Range, dB(A),	Limit Level, dB(A),
	L <sub>eg (30 mins)</sub>	L <sub>eq (30 mins)</sub>	L <sub>eq (30 mins)</sub>
NMS2	67*	66 – 68*	75
NMS3A	66*	58 – 68*	70

<sup>\*+3</sup>dB(A) Façade correction included

- 3.7.2 No noise Action Level and Limit Level exceedance was recorded at all monitoring stations in the reporting month.
- 3.7.3 Major noise sources during the noise monitoring included construction activities of the Project, construction activities by other contracts and nearby traffic noise.
- 3.7.4 The event action plan is annexed in Appendix L.

# 4 WATER QUALITY MONITORING

# 4.1 Monitoring Requirements

4.1.1 Impact water quality monitoring was carried out to ensure that any deterioration of water quality was detected, and that timely action was taken to rectify the situation. For impact water quality monitoring, measurements were taken in accordance with the Project Specific EM&A Manual. Appendix D shows the established Action/Limit Levels for the environmental monitoring works.

# 4.2 Monitoring Equipment

4.2.1 Table 4.1 summarises the equipment used in the impact water quality monitoring programme.

Table 4.1 Water Quality Monitoring Equipment

Equipment	Brand and Model
Dissolved Oxygen (DO) and Temperature Meter, Salinity Meter and Turbidimeter	YSI Model 6820
pH Meter	YSI Model 6820 or Thermo Orion 230A+
Positioning Equipment	JRC DGPS 224 Model JLR-4341 with J-NAV 500 Model NWZ4551
Water Depth Detector	Eagle Cuda-168
Water Sampler	Kahlsio Water Sampler (Vertical) 2.2 L with messenger

# 4.3 Monitoring Parameters, Frequency and Duration

4.3.1 Table 4.2 summarises the monitoring parameters, frequency and monitoring depths of impact water quality monitoring as required in the Project Specific EM&A Manual.

Table 4.2 Impact Water Quality Monitoring Parameters and Frequency

Monitoring Stations	Parameter, unit	Frequency	No. of depth
Impact Stations: IS5, IS(Mf)6, IS7, IS8, IS(Mf)9, IS10, IS(Mf)11, IS(Mf)16, IS17  Control/Far Field Stations: CS(Mf)3, CS(Mf)5, CS4, CS6, CSA  Sensitive Receiver Stations: SR3-SR7, SR10A&SR10B	<ul> <li>Depth, m</li> <li>Temperature, °C</li> <li>Salinity, ppt</li> <li>Dissolved     Oxygen (DO),     mg/L</li> <li>DO Saturation, %</li> <li>Turbidity, NTU</li> <li>pH</li> <li>Suspended     Solids (SS), mg/L</li> </ul>	Three times per week during mid- ebb and mid- flood tides (within ± 1.75 hour of the predicted time)	3 (1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth is less than 6 m, in which case the middepth station may be omitted. Should the water depth be less than 3 m, only the mid-depth station will be monitored).



# 4.4 Monitoring Locations

- 4.4.1 In accordance with the Project Specific EM&A Manual, twenty-one stations (9 Impact Stations, 7 Sensitive Receiver Stations and 5 Control/Far Field Stations) were designated for impact water quality monitoring. The nine Impact Stations (IS) were chosen on the basis of their proximity to the reclamation and thus the greatest potential for water quality impacts, the seven Sensitive Receiver Stations (SR) were chosen as they are close to the key sensitive receives and the five Control/ Far Field Stations (CS) were chosen to facilitate comparison of the water quality of the IS stations with less influence by the Project/ ambient water quality conditions.
- 4.4.2 Due to safety concern and topographical condition of the original locations of SR4 and SR10B, alternative impact water quality monitoring stations, naming as SR4(N) and SR10B(N), were adopted, which are situated in vicinity of the original impact water quality monitoring stations (SR4 and SR10B) and could be reachable.
- 4.4.3 Same baseline and Action Level for water quality, as derived from the baseline monitoring data recorded, were adopted for these alternative impact water quality monitoring stations.
- 4.4.4 The locations of these monitoring stations are summarized in Table 4.3 and depicted in Figure 3.

Table 4.3 Impact Water Quality Monitoring Stations

Station	Description	East	North
IS5	Impact Station (Close to HKBCF construction site)	811579	817106
IS(Mf)6	Impact Station (Close to HKBCF construction site)	812101	817873
IS7	Impact Station (Close to HKBCF construction site)	812244	818777
IS8	Impact Station (Close to HKBCF construction site)	814251	818412
IS(Mf)9	Impact Station (Close to HKBCF construction site)	813273	818850
IS10	Impact Station (Close to HKBCF construction site)	812577	820670
IS(Mf)11	Impact Station (Close to HKBCF construction site)	813562	820716
IS(Mf)16	Impact Station (Close to HKBCF construction site)	814328	819497
IS17	Impact Station (Close to HKBCF construction site)	814539	820391
SR3	Sensitive receivers (San Tau SSSI)	810525	816456
SR4(N)	Sensitive receivers (Tai Ho)	814705	817859
SR5	Sensitive receivers (Artificial Reef in NE Airport)	811489	820455
SR6	Sensitive receivers (Sha Chau and Lung Kwu Chau Marine Park)	805837	821818
SR7	Sensitive receivers (Tai Mo Do)	814293	821431
SR10A	Sensitive receivers (Ma Wan FCZ)1	823741	823495
SR10B(N)	Sensitive receivers (Ma Wan FCZ)2	823683	823187
CS(Mf)3	Control Station	809989	821117
CS(Mf)5	Control Station	817990	821129
CS4	Control Station	810025	824004
CS6	Control Station	817028	823992
CSA	Control Station	818103	823064



# 4.5 Monitoring Methodology

#### 4.5.1 Instrumentation

(a) The in-situ water quality parameters, viz. dissolved oxygen, temperature, salinity, turbidity and pH, were measured by multi-parameter meters (i.e. Model YSI 6820 CE-C-M-Y) and pH meter (i.e. Thermo Orion 230A+) respectively.

#### 4.5.2 Operating/Analytical Procedures

- (a) Digital Differential Global Positioning Systems (DGPS) were used to ensure that the correct location was selected prior to sample collection.
- (b) Portable, battery-operated echo sounders were used for the determination of water depth at each designated monitoring station.
- (c) All in-situ measurements were taken at 3 water depths, 1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth was less than 6 m, in which case the mid-depth station was omitted. Should the water depth be less than 3 m, only the mid-depth station was monitored.
- (d) At each measurement/sampling depth, two consecutive in-situ monitoring (DO concentration and saturation, temperature, turbidity, pH, salinity) and water sample for SS. The probes were retrieved out of the water after the first measurement and then re-deployed for the second measurement. Where the difference in the value between the first and second readings of DO or turbidity parameters was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- (e) Duplicate samples from each independent sampling event were collected for SS measurement. Water samples were collected using the water samplers and the samples were stored in high-density polythene bottles. Water samples collected were well-mixed in the water sampler prior to pre-rinsing and transferring to sample bottles. Sample bottles were pre-rinsed with the same water samples. The sample bottles were then be packed in cool-boxes (cooled at 4°C without being frozen), and delivered to ALS Technichem (HK) Pty Ltd. for the analysis of suspended solids concentrations. The laboratory determination work would be started within 24 hours after collection of the water samples. ALS Technichem (HK) Pty Ltd. is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes. For QA/QC procedures, one duplicate samples of every batch of 20 samples was analyzed.
- (f) The analysis method and reporting and detection limit for SS is shown in Table 4.4.

Table 4.4 Laboratory Analysis for Suspended Solids

Parameters	Instrumentation	Analytical Method	Reporting Limit	Detection Limit
Suspended Solid (SS)	Weighting	APHA 2540-D	0.5mg/L	0.5mg/L

(g) Other relevant data were recorded, including monitoring location / position, time, water depth, tidal stages, weather conditions and any special phenomena or work underway at the construction site in the field log sheet for information.

#### 4.5.3 Maintenance and Calibration

- (a) All in situ monitoring instruments would be calibrated and calibrated by ALS Technichem (HK) Pty Ltd. before use and at 3-monthly intervals throughout all stages of the water quality monitoring programme. Calibration details are provided in Appendix E.
- (b) The dissolved oxygen probe of YSI 6820 was calibrated by wet bulb method. Before the calibration routine, the sensor for dissolved oxygen was thermally equilibrated in water-saturated air. Calibration cup is served as a calibration chamber and it was loosened from airtight condition before it is used for the calibration. Calibration at ALS Technichem (HK) Pty Ltd. was carried out once every three months in a water sample with a known concentration



- of dissolved oxygen. The sensor was immersed in the water and after thermal equilibration, the known mg/L value was keyed in and the calibration was carried out automatically.
- (c) The turbidity probe of YSI 6820 is calibrated two times a month. A zero check in distilled water was performed with the turbidity probe of YSI 6820 once per monitoring day. The probe will be calibrated with a solution of known NTU at ALS Technichem (HK) Pty Ltd. once every three months.

# 4.6 Monitoring Schedule for the Reporting Month

4.6.1 The schedule for impact water quality monitoring in October 2012 is provided in Appendix F.

#### 4.7 Results and Observations

- 4.7.1 Impact water quality monitoring was conducted at all designated monitoring stations in the reporting month. Impact water quality monitoring results and graphical presentations are provided in Appendix J.
- 4.7.2 One (1) Action Level exceedance was recorded for turbidity (in NTU) and one (1) Limit Level exceedance was recorded for suspended solids (mg/L) at monitoring station SR5 in the reporting month. Number of exceedance recorded in the reporting month at each impact station is summarized in Table 4.5.




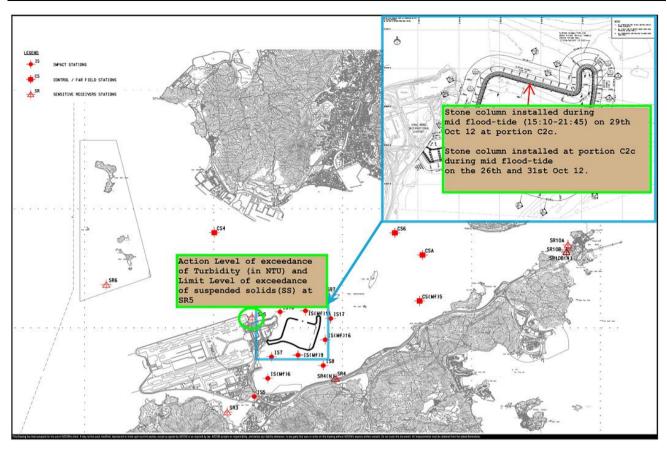


Table 4.5 Summary of Water Quality Exceedances

Station	Exceedance Level	DO (	(S&M)	DO (E	Bottom)	Turl	bidity	,	SS	To	otal
	20101	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood
IS5	Action	0	0	0	0	0	0	0	0	0	0
155	Limit	0	0	0	0	0	0	0	0	0	0
IS(Mf)6	Action	0	0	0	0	0	0	0	0	0	0
13(111)6	Limit	0	0	0	0	0	0	0	0	0	0
IS7	Action	0	0	0	0	0	0	0	0	0	0
137	Limit	0	0	0	0	0	0	0	0	0	0
IS8	Action	0	0	0	0	0	0	0	0	0	0
130	Limit	0	0	0	0	0	0	0	0	0	0
IS(Mf)9	Action	0	0	0	0	0	0	0	0	0	0
13(111)9	Limit	0	0	0	0	0	0	0	0	0	0
IS10	Action	0	0	0	0	0	0	0	0	0	0
1310	Limit	0	0	0	0	0	0	0	0	0	0
IS(Mf)11	Action	0	0	0	0	0	0	0	0	0	0
13(1011)11	Limit	0	0	0	0	0	0	0	0	0	0
IS(Mf)16	Action	0	0	0	0	0	0	0	0	0	0
13(1011)10	Limit	0	0	0	0	0	0	0	0	0	0
IS17	Action	0	0	0	0	0	0	0	0	0	0
1317	Limit	0	0	0	0	0	0	0	0	0	0
SR3	Action	0	0	0	0	0	0	0	0	0	0
SKS	Limit	0	0	0	0	0	0	0	0	0	0
SR4(N)	Action	0	0	0	0	0	0	0	0	0	0
31(4(11)	Limit	0	0	0	0	0	0	0	0	0	0
SR5	Action	0	0	0	0	0	1 (29 Oct 12)	0	1 (29 Oct 12)	0	2 (29 Oct 12)
	Limit	0	0	0	0	0	0	0	0	0	0
SR6	Action	0	0	0	0	0	0	0	0	0	0
SINO	Limit	0	0	0	0	0	0	0	0	0	0
SR7	Action	0	0	0	0	0	0	0	0	0	0
OIX/	Limit	0	0	0	0	0	0	0	0	0	0
SR10A	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0
SR10B	Action	0	0	0	0	0	0	0	0	0	0
(N)	Limit	0	0	0	0	0	0	0	0	0	0
Total	Action	0	0	1	0	0	0	0	0		2 Oct 12)
	Limit	0	0	0	0	0	0	0	0		0

Note: S: Surface; and M: Mid-depth.

- 4.7.3 One (1) turbidity Action Level exceedance and one (1) suspended solids Limit Level exceedance were recorded on 29th Oct 2012 during mid-flood tide at Sensitive Receiver Station SR5. For Action Level exceedance at measured turbidity (NTU), 41 (NTU) was recorded. For Limit Level exceedance at measured Suspended Solids (mg/L), 38.4 mg/L was recorded.
- 4.7.4 For the exceedances recorded at SR5, it was found that stone column installation was carried out during mid-flood tide at Portion C2c by FTB 19 and FTB23. Location plan showing the locations of the mentioned works is shown below:



- 4.7.5 Turbidity and suspended solids values recorded at Impacts Stations closer to the works area (e.g. IS10 and IS(Mf)11) are all below the Action and Limit Level during the mid-flood tide on the same day.
- 4.7.6 Same work at same portion was carried out on the day(s) on 26th October and 31st October while no exceedance was recorded on these two days at the same tide.
- 4.7.7 Strong wind and rough sea condition was experienced during the monitoring period, which is likely to affect the ambient water quality in such shallow water condition.
- 4.7.8 The exceedance was considered as non-project related.
- 4.7.9 The event action plan is annexed in Appendix L.



### 5 **DOLPHIN MONITORING**

# 5.1 Monitoring Requirements

- 5.1.1 Vessel based surveys for the Chinese White Dolphin (CWD), Sousa chinensis, are to be conducted by a dedicated team comprising a qualified marine mammal ecologist and experienced marine mammal observers (MMOs). The purpose of the surveys are to evaluate the impact of the HKCBF reclamation and, if deemed detrimental, to take appropriate action as per the EM&A manual.
- 5.1.2 This 'Impact Monitoring' follows several months of 'Baseline Monitoring' so similar survey methodologies have been adopted to facilitate comparisons between datasets. Further, the data collected are compatible with, and are available for, incorporation into the data set managed by the Agriculture, Fisheries and Conservation Department (AFCD) as part of Hong Kong's long term Marine Mammal Monitoring Programme.

## 5.2 Monitoring Equipment

5.2.1 Table 5.1 summarises the equipment used for the impact dolphin monitoring.

Table 5.1 Dolphin Monitoring Equipment

Equipment	Model
Commercially licensed motor vessel	15m in length with a 4.5m viewing platform
Global Positioning System (GPS) x2	Garmin 18X-PC
	Geo One Phottix
Computers (Corei7) x2	Windows /MSO 10
	Logger
AIS receiver	Logger – GPS linked
Camera	Nikon D90 300m 2.8D fixed focus
	Nikon D90 20-300m zoom lens
Laser Rangefinder	Infinitor LRF1000/Visionking 900
Marine Binocular x3	Nexus 7 x 50 marine binocular with compass
	and reticules
	Fujinon 7 x 50 marine binocular with compass
	and reticules

# 5.3 Monitoring Frequency and Conditions

- 5.3.1 Dolphin monitoring is conducted twice per month in each survey area.
- 5.3.2 Dolphin monitoring is conducted only when visibility is good (e.g., over 1km) and the sea condition is at a Beaufort Sea State of 4 or better.
- 5.3.3 When thunder storm, black rain or typhoon warnings are in force, all survey effort is stopped.

### 5.4 Monitoring Methodology and Location

5.4.1 The impact dolphin monitoring is vessel-based and combines line-transect and photo-ID methodology. The survey follows pre-set and fixed transect lines in the two areas defined by AFCD as:

Northeast Lantau survey area; and

Northwest Lantau survey area.

5.4.2 The co-ordinates for the transect lines and layout map have been provided by AFCD and are shown in Table 5.2 and Figure 4.



Table 5.2 Impact Dolphin Monitoring Line Transect Co-ordinates (Provided by AFCD)

	HK Grid System		Long Lat i	n WGS84
ID	Х	Υ	Long	Lat
1	804671	814577	113.870308	22.269741
1	804671	831404 113.869975		22.421696
2	805475	815457	113.878087	22.277704
2	805477	826654	113.877896	22.378814
3	806464	819435	113.887615	22.313643
3	806464	822911	113.887550	22.345030
4	807518	819771	113.897833	22.316697
4	807518	829230	113.897663	22.402113
5	808504	820220	113.907397	22.320761
5	808504	828602	113.907252	22.396462
6	809490	820466	113.916965	22.323003
6	809490	825352	113.916884	22.367128
7	810499	820690	113.926752	22.325043
7	810499	824613	113.926688	22.360464
8	811508	820847	113.936539	22.326475
8	811508	824254	113.936486	22.357241
9	812516	820892	113.946329	22.326894
9	812516	824254	113.946279	22.357255
10	813525	818270	113.956156	22.303225
10	813525	824657	113.956065	22.360912
11	814556	818449	113.966160	22.304858
11	814556	820992	113.966125	22.327820
12	815542	818807	113.975726	22.308109
12	815542	824882	113.975647	22.362962
13	816506	819480	113.985072	22.314192
13	816506	824859	113.985005	22.362771
14	817537	820220	113.995070	22.320883
14	817537	824613	113.995018	22.360556
15	818568	820735	114.005071	22.325550
15	818568	824433	114.005030	22.358947
16	819532	821420	114.014420	22.331747
16	819532	824209	114.014390	22.356933
17	820451	822125	114.023333	22.338117
17	820451	823671	114.023317	22.352084
18	821504	822371	114.033556	22.340353
18	821504	823761	114.033544	22.352903
19	822513	823268	114.043340	22.348458
19	822513	824321	114.043331	22.357971
20	823477	823402	114.052695	22.349680
20	823477	824613	114.052686	22.360610
21	805476	827081	113.877878	22.382668
21	805476	830562	113.877811	22.414103
22	806464	824033	113.887520	22.355164
22	806464	829598	113.887416	22.405423
23	814559	821739	113.966142	22.334574
23	814559	824768	113.966101	22.361920

5.4.3 Due to the presence of deployed silt curtain systems at the site boundaries of the Project, some of the transect lines could not be fully surveyed during the regular survey.



# 5.5 Monitoring Procedures

- 5.5.1 The study area incorporates 23 transects which are to be surveyed twice per month. Each survey day lasts approximately 9 hours.
- 5.5.2 The survey vessel departs from Tung Chung Development Pier, Tsing Yi Public Pier or the nearest safe and convenient pier.
- 5.5.3 When the vessel reaches the start of a transect line, "on effort" survey begins. Areas between transect lines and traveling to and from the study area are defined as "off effort".
- 5.5.4 The transect line is surveyed at a speed of 6-8 knots (11-14 km/hr). For the sake of safety, the speed was sometimes a bit slower to avoid collision with other vessels. During some periods, tide and current flow in the survey areas exceeds 7 knots which can affect survey speed. There are a minimum of four marine mammal observers (MMOs) present on each survey, rotating through four positions, observers (2), data recorder (1) and 'rest' (1). Rotations occur every 30 minutes or at the end of dolphin encounters. The data recorder records effort, weather and sightings data directly onto the programme Logger. The observers search with naked eye and binoculars between 90° and 270° abeam (bow being 0°).
- 5.5.5 When a group of dolphins is sighted, position, bearing and distance data are recorded immediately onto the computer and, after a short observation, an estimate made of group size. These parameters are linked to the time-GPS-ships data which are automatically stored in the programme Logger throughout the survey period. In this manner, information on heading, position, speed, weather, effort and sightings are stored in a format suitable for use with DISTANCE software for subsequent line transect analyses.
- 5.5.6 Once the vessel leaves the transect line, it is deemed to be "off effort". The dolphins are approached with the purpose of taking high resolution pictures for proper photo-identification of individual CWD. Attempts to photograph all dolphins in the group are made. Both the left and right hand sides of the dorsal fin area of each dolphin in the group are photographed, if possible. On finishing photographing, the vessel will return to the transect line at the point of departure and "on effort" survey is resumed.
- 5.5.7 Sightings which are made while on the transect line are referred to as "on effort sightings", while not on the actual transect line are referred to as an "opportunistic sightings" (e.g. another group of dolphins is sighted while travelling back to the transect line). Only "on effort sightings" can be used in analyses which require effort or rate quantification, e.g., encounter rate per 100km searched. This is also how "on effort sightings" are treated in the baseline report. "Opportunistic sightings" provide additional information on individual habitat use and population distribution and they are noted accordingly.
- 5.5.8 As time and GPS data are automatically logged throughout the survey and are linked to sightings data input, start and end times of encounters and deviation from the transect lines are recorded and can be subsequently reviewed.

# 5.6 Monitoring Schedule for the Reporting Month

5.6.1 The schedule for dolphin monitoring in October 2012 is provided in Appendix F.

#### 5.7 Results and Observations

- 5.7.1 Dolphin surveys were conducted on 11, 12, 23 and 24 October 2012. In summary, a total of 222.9km of "on effort" survey was conducted while 100% of "on effort" survey was conducted under favourable conditions (Beaufort Sea State 3 or better). The details are shown below:-
- 5.7.2 The effort summary and sightings data are shown in Tables 5.3 and 5.4, respectively. The survey effort conducted in October 2012 are plotted in Figure 5a-c. For Table 5.3, only on-effort information is



included. Transects conducted in Beaufort Sea State larger than 3 and time/distance with sightings are not included. Compared to previous monthly reports, the whole number Beaufort Sea State scale is used so as to ease comparison with other dolphin monitoring reports.

Table 5.3 Impact Dolphin Monitoring Survey Effort Summary

Date	Status	Beaufort Sea State* (on effort only)	Distance (km)
11-10-12	ON	1	30
11-10-12	ON	2	9.8
	39.8		
12-10-12	ON	1	48.3
12-10-12	ON	2	15.1
12-10-12	ON	3	3.8
	67.2		
23-10-12	ON	1	37.8
23-10-12	ON	2	19.9
23-10-12	ON	3	4
	61.7		
24-10-12	ON	1	8
24-10-12	ON	2	20.6
24-10-12	ON	3	25.6
		Total	54.2
	222.9		

<sup>\*</sup>Remark: Surveys conduct under Beaufort Sea State 3 or below are considered as under favourable condition.

Table 5.4 Impact Dolphin Monitoring Survey Details in October 2012

Date	Location (transect line)	No. Sightings "ON EFFORT"	No. Sightings "OPPORTUNISTIC"
11-10-12	NW and NE Lantau (9-20,23)	1	0
12-10-12	NW (1-8,21,22)	6	1
23-10-12	NW and NE Lantau (5-20,23)	1	2
24-10-12	NW Lantau (1-4,21,22)	1	3
Total in October 2012		9	6

- 5.7.3 A total of fifteen dolphin sightings were recorded during the two surveys, one on the 11 October 2012, seven on the 12 October 2012, three on the 23 October 2012 and four on the 24 October 2012. Of the fifteen sightings, nine were "on effort" (which are all under favourable condition) and six were "opportunistic". A total of forty seven individuals were sighted from the two impact dolphin surveys in the reporting period. Sighting details are summarised and plotted in Appendix K and Figure 5c, respectively.
- 5.7.4 Behaviour: five groups were feeding but only two of these groups were associated with a fishing vessel (hang trawler); five groups were recorded as travelling; two groups were associated with multiple behaviour (feeding and surface active); one group was recorded as surface active and the behaviour of two groups were noted as unknown.
- 5.7.5 Noteworthy Observations: three mother and calf pairs were noted although two of these sightings were likely the same pair.
- 5.7.6 The event action plan is annexed in Appendix L.



#### 6 ENVIRONMENTAL SITE INSPECTION AND AUDIT

# 6.1 Site Inspection

- 6.1.1 Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. In the reporting month, 4 site inspections were carried out on 4, 11, 18, 25 October 2012.
- 6.1.2 Particular observations during the site inspections are described below:

#### Air Quality

6.1.3 The Contractor was reminded to check the operating plants on barge regularly and carry out maintenance /repair (if necessary), to avoid any dark smoke emission. (Reminder)

#### Noise

6.1.4 No adverse observation was identified in the reporting month.

# Water Quality

6.1.5 No adverse observation was identified in the reporting month.

#### Chemical and Waste Management

- 6.1.6 Oil drums were stored inside the drip trays to retain any oil leakage at Works Area WA4. (Closure of item in the reporting month))
- 6.1.7 Oil stains were found on barge and near power pack at barge San Hang Qi 7. Although immediate action of clearing up the oil stains was taken by the Contractor. The Contractor was reminded that proper measures like drip trays/tarpaulin sheets should be provided to retain any leaked oil from power pack. Bunding was provided to retain leaked oil from the power pack on Barge San Hang Qi 7 within the reporting month. (Closure of item in the reporting month)
- 6.1.8 Oil drums were found improperly stored on barge San Hang Qi 7. Drip trays should be provided to oil drums stored within works areas to retain any leaked oil. Oil drums were stored inside the bunding on barge within the reporting month. (Closure of item in the reporting month)
- 6.1.9 A drum of waste oil was found improperly stored on barge Sun Moon Kee. The Contractor was reminded to place the waste oil drum to designated chemical waste storage area for temporarily storage. The chemical waste container should also be labelled. As noted by Contractor that the barge left the site area. (Closure of item in the reporting month)
- 6.1.10 Oil stains was found on Barge San Hang Bo 401. However, immediate action of clearing up the oil stains by absorbents was taken by the Contractor. (Closure of item in the reporting month)
- 6.1.11 Power pack was found improperly stored on Barge San Hang Bo 401. The Contractor was reminded that proper measures like drip trays/tarpaulin sheets should be provided to retain any leaked oil from power pack on the barge. Power pack improperly stored on Barge San Hang Bo 401 was removed within the reporting month. (Closure of item in the reporting month).
- 6.1.12 Oily mixtures accumulated inside the power pack on Barge San Hang Bo 305 were observed. However, immediate action of clearing up the oily mixtures by absorbents was taken by the Contractor. (Closure of item in the reporting month).
- 6.1.13 Open holes was found in the bunding for storage oil drums and power pack at Barge San Hang Bo 208. The Contractor was reminded to seal the open holes to retain any oil leakage. (Follow-up)



6.1.14 The contractor was reminded to disposal the oil absorbent materials of as chemical wastes and provide a proper chemical waste storage area on Barge San Hang Bo 208. (reminder)

#### **Landscape and Visual Impact**

6.1.15 No relevant works was carried out in the reporting month.

#### Others

- 6.1.16 No adverse observation was identified in the reporting month.
- 6.1.17 The Contractor had rectified most of the observations as identified during environmental site inspection in the reporting month. Rectifications of remaining identified items are undergoing by the Contractor. Follow-up inspections on the status on provision of mitigation measures will be conducted to ensure all identified items are mitigated properly.

# 6.2 Advice on the Solid and Liquid Waste Management Status

- 6.2.1 The Contractor had registered as a chemical waste producer for this Project. Receptacles were available for general refuse collection and sorting.
- 6.2.2 As advised by the Contractor, 29,262.9 m³ of public fill and 367,62.8 m³ of rock fill were imported for the Project use in the reporting period. 1,000.0 L of chemical waste (liquid) were generated and disposed of in the reporting period. 7.20 tonnes of general refuse were generated and disposed of in the reporting period. Monthly summary of waste flow table is detailed in Appendix M.
- 6.2.3 The Contractor is advised to properly maintain on site C&D materials and wastes storage, collection, sorting and recording system, dispose of C&D materials and wastes at designated ground and maximize reuse / recycle of C&D materials and wastes. The Contractor is reminded to properly maintain the site tidiness and dispose of the wastes accumulated on site regularly and properly.
- 6.2.4 The Contractor is reminded that chemical waste should be properly treated and stored temporarily in designated chemical waste storage area on site in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes.



# 6.3 Environmental Licenses and Permits

6.3.1 The environmental licenses and permits for the Project and valid in the reporting month is summarized in Table 6.1.

Table 6.1 Summary of Environmental Licensing and Permit Status

Statutory Reference	License/ Permit	License or Permit No.	Valid Period		License/ Permit	Remarks
			From	То	Holder	
EIAO	Environmental Permit	EP- 353/2009/E	16/10/2012	N/A	- HyD	Hong Kong – Zhuhai – Macao Bridge Hong Kong Boundary Crossing Facilities
		EP- 354/2009/A	08/12/2010	N/A		Tuen Mun – Chek Lap Kok Link (TMCLKL Southern Landfall Reclamation only)
APCO	NA notification		30/12/2011		CHEC	Works Area WA2 and WA3
APCO	NA notification		17/01/2012		CHEC	Works Area WA4
WPCO	Discharge License	N/A	Application in process	N/A	CHEC	Discharge of Construction Runoff
WDO	Chemical Waste Producer Registration	5213-951- C1186-21	30/3/2012	N/A	CHEC	Chemical waste produced in Contract HY/2010/02
WDO	Chemical Waste Producer Registration	N/A	Applications in process	N/A	CHEC	Registration as Chemical Waste Producer at To Kau Wan(WA4) & TKO 137(FB)
WDO	Billing Account for Disposal of Construction Waste	7014181	05/12/2011	N/A	CHEC	Waste disposal in Contract HY/2010/02
NCO	Construction Noise Permit	GW-RS0378- 12	16/4/2012	15/10/2012	CHEC	Works Area WA3 in Siu Ho Wan
NCO	Construction Noise Permit	GW-RS0861- 12	24/8/2012	23/2/2013	CHEC	Works Area WA2 in Tung Chung
NCO	Construction Noise Permit	GW-RS1063- 12	12/10/2012	09/4/2013	CHEC	Marine-based areas in Contract HY/2010/02
NCO	Construction Noise Permit	N/A	Application in process	N/A	CHEC	Works Area WA 3 in Contract HY/2010/02
NCO	Construction Noise Permit	N/A	Application in process	N/A	CHEC	Works Area WA 4 in Contract HY/2010/02



# 6.4 Implementation Status of Environmental Mitigation Measures

- 6.4.1 In response to the site audit findings, the Contractors carried out corrective actions.
- 6.4.2 A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in Appendix C. Most of the necessary mitigation measures were implemented properly.
- 6.4.3 Training of marine travel route for marine vessels operator was given to relevant staff and relevant records were kept properly.
- 6.4.4 Regarding the implementation of dolphin monitoring and protection measures (i.e. implementation of Dolphin Watching Plan, Dolphin Exclusion Zone and Silt Curtain integrity Check), regular checking were conducted by the experienced MMOs within the works area to ensure no dolphin was trapped by the enclosed silt curtain systems. Any dolphin spotted within the enclosed silt curtain systems was reported and recorded. Relevant procedures were followed and measures were well implemented. Silt curtain systems were also inspected timely in accordance to the submitted plan. All inspection records were kept properly.
- 6.4.5 Acoustic decoupling measures on noisy plants on construction vessels were checked regularly and these measures were well implemented.

#### 6.5 Summary of Exceedances of the Environmental Quality Performance Limit

- 6.5.1 All 1-hour TSP and 24-hour TSP results were below the Action and Limit Level at all monitoring locations in the reporting month.
- 6.5.2 For construction noise, no Action and Limit Level exceedance was recorded at all monitoring stations in the reporting period.
- 6.5.3 One (1) Action Level exceedance was recorded at measured turbidity (in NTU) and one (1) Limit Level exceedance were recorded at measured suspended solids (mg/L) in the reporting month. Investigation results show that the exceedances were not due to the Project works.
- 6.5.4 Cumulative statistics on exceedance is provided in Appendix N.

# 6.6 Summary of Complaints, Notification of Summons and Successful Prosecutions

- 6.6.1 The Environmental Complaint Handling Procedure is annexed in Figure 6.
- 6.6.2 One (1) environmental complaint was received on 22 Oct 2012 regarding observed silty plume and oil stain near the Tung Chung New Development Ferry Pier.
- 6.6.3 As confirmed by the Contractor, there is no working barge from HKBCF (HY/2010/02) that had passed through or approached to the area near the new development pier in Tung Chung.
- 6.6.4 Thus the complaint was considered as not project-related.
- 6.6.5 No notification of summons and prosecution was received in the reporting period.
- 6.6.6 Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix N.



### 7 FUTURE KEY ISSUES

# 7.1 Construction Programme for the Coming Months

7.1.1 As informed by the Contractor, the major works for the Project in November and December 2012 will be:-

#### Marine-based Works

- Laying geo-textile
- Maintenance of Silt curtain
- Stone column installation
- Construction of cellular structure
- Backfill cellular structure
- Sand filling trial
- Sand filling
- Sand blanket
- Band drain installation
- Arc cell connection

#### Land-based Works

- Site office erection and construction at site area WA2
- Hoarding erection at Work Areas Portion D and WA2
- Sign board erection at area WA2
- Maintenance works of Public Works Regional Laboratory at site area WA3
- Geotextile fabrication at Works Area WA2
- Stone column and cellular wall installation barges setup and their maintenance works at Works Area WA4

#### 7.2 Key Issues for the Coming Month

- 7.2.1 Key issues to be considered in the coming months:-
  - Site runoff should be properly collected and treated prior to discharge;
  - Minimize loss of sediment from filling works;
  - Regular review and maintenance of silt curtain systems, drainage systems and desilting facilities;
  - Exposed surfaces/soil stockpiles should be properly treated to avoid generation of silty surface runoff during rainstorm;
  - Regular review and maintenance of wheel washing facilities provided at all site entrances/exits;
  - Conduct regular inspection of various working machineries and vessels within works areas to avoid any dark smoke emission;
  - Suppress dust generated from work processes with use of bagged cements, earth movements, excavation activities, exposed surfaces/soil stockpiles and haul road traffic;
  - Quieter powered mechanical equipment should be used;
  - Provision of proper and effective noise control measures for operating equipment and machinery on-site, such as erection of movable noise barriers or enclosure for noisy plants;
  - Closely check and replace the sound insulation materials regularly;
  - Better scheduling of construction works to minimize noise nuisance;
  - Properly store and label oil drums and chemical containers placed on site;
  - Proper chemicals, chemical wastes and wastes management;
  - Maintenance works should be carried out within roofed, paved and confined areas;
  - Collection and segregation of construction waste and general refuse on land and in the sea should be carried out properly and regularly; and
  - Proper protection and regular inspection of existing trees, transplanted/retained trees.

# 7.3 Monitoring Schedule for the Coming Month

7.3.1 The tentative schedule for environmental monitoring in November 2012 is provided in Appendix F.



#### CONCLUSIONS AND RECOMMENDATIONS 8

#### 8.1 **Conclusions**

- 8.1.1 The construction phase and EM&A programme of the Project commenced on 12 March 2012.
- All 1-hour TSP and 24-hour TSP results were below the Action and Limit Level at all monitoring 8.1.2 locations in the reporting month.
- 8.1.3 For construction noise, no Action and Limit Level exceedance was recorded at all monitoring stations in the reporting period.
- 8.1.4 One (1) Action Level exceedance was recorded at measured turbidity (in NTU) and one (1) Limit Level exceedance was recorded at measured suspended solids (mg/L) in the reporting month. Investigation results show that the exceedances were not due to the Project works.
- 8.1.5 A total of fifteen dolphin sightings were recorded during the two surveys, one on the 11 October 2012, seven on the 12 October 2012, three on the 23 October 2012 and four on the 24 October 2012. Of the fifteen sightings, nine were "on effort" (which are all under favourable condition) and six were "opportunistic". A total of forty seven individuals were sighted from the two impact dolphin surveys in the reporting period.
- 8.1.6 The predominant behaviour of the dolphin observed were feeding and travelling. Five groups were feeding but only two of these groups were associated with a fishing vessel (hang trawler); five groups were recorded as travelling; two groups were associated with multiple behaviour (feeding and surface active); one group was recorded as surface active and the behaviour of two groups were noted as unknown.
- 8.1.7 Environmental site inspection was carried out 4 times in October 2012. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site audits.
- One (1) environmental complaint was received in the reporting month. Investigation results show that 8.1.8 the complaint was not Project-related.
- 8.1.9 No notification of summons and prosecution was received in the reporting period.

#### 8.2 Recommendations

8.2.1 According to the environmental site inspections performed in the reporting month, the following recommendations were provided:-

#### Air Quality Impact

- All working plants and vessels on site should be regularly inspected and properly maintained to avoid dark smoke emission.
- All vehicles should be washed to remove any dusty materials before leaving the site.
- Haul roads should be sufficiently dampened to minimize fugitive dust generation.
- Wheel washing facilities should be properly maintained and reviewed to ensure properly functioning.
- Temporary exposed slopes and open stockpiles should be properly covered.
- Enclosure should be erected for cement debagging, batching and mixing operations.
- Water spraying should be provided to suppress fugitive dust for any dusty construction activity.

#### Construction Noise Impact

Quieter powered mechanical equipment should be used as far as possible.



- Noisy operations should be oriented to a direction away from sensitive receivers as far as possible.
- Proper and effective noise control measures for operating equipment and machinery on-site should be provided, such as erection of movable noise barriers or enclosure for noisy plants.
   Closely check and replace the sound insulation materials regularly
- Vessels and equipment operating should be checked regularly and properly maintained.
- Noise Emission Label (NEL) shall be affixed to the air compressor and hand-held breaker operating within works area.
- Better scheduling of construction works to minimize noise nuisance.

### Water Quality Impact

- Regular review and maintenance of silt curtain systems, drainage systems and desilting facilities in order to make sure they are functioning effectively.
- Construction of seawall should be completed as early as possible.
- Regular inspect and review the loading process from barges to avoid splashing of material.
- Silt, debris and leaves accumulated at public drains, wheel washing bays and perimeter uchannels and desilting facilities should be cleaned up regularly.
- Silty effluent should be treated/ desilted before discharged. Untreated effluent should be prevented from entering public drain channel.
- Proper drainage channels/bunds should be provided at the site boundaries to collect/intercept the surface run-off from works areas.
- Exposed slopes and stockpiles should be covered up properly during rainstorm.

#### Chemical and Waste Management

- All types of wastes, both on land and floating in the sea, should be collected and sorted properly
  and disposed of timely and properly. They should be properly stored in designated areas within
  works areas temporarily.
- All chemical containers, batteries and oil drums should be properly stored and labelled.
- All plants and vehicles on site should be properly maintained to prevent oil leakage. Proper measures, like drip trays and/or bundings, should be provided for retaining leaked oil/chemical from plants.
- All kinds of maintenance works should be carried out within roofed, paved and confined areas.
- All drain holes of the drip trays utilized within works areas should be properly plugged to avoid any oil and chemical waste leakage.
- Oil stains on soil surface, accumulated oil mixture and empty chemical containers should be cleared and disposed of as chemical waste.
- Regular review should be conducted for working barges and patrol boats to ensure sufficient
  measures and spill control kits were provided on working barges and patrol boats to avoid any
  spreading of leaked oil/chemicals.

#### Landscape and Visual Impact





 All existing, retained/transplanted trees at the works areas should be properly fenced off and regularly inspected.

