

## ***China Harbour – Zhen Hua Joint Venture***

**Contract No.: CV/2015/07  
Handling of Surplus Public Fill  
(2016-2018)**

**TSEUNG KWAN O AREA 137 FILL BANK  
QUARTERLY EM&A SUMMARY REPORT  
NO.1**

**(FROM 12 MAY 2017 TO 31 JULY 2017)**

Prepared by:

LAW, Sau Yee  
Senior Environmental Officer

Checked by:

LAU, Chi Leung  
Environmental Team Leader

Issue Date: 01 September 2017

Report No.: ENA75179

Ref.: CEDPFRSFEM02\_0\_0098L.17

6 September 2017

By Email and Fax No.: 2695 3944

ETS-Testconsult Limited  
8/F, Block B, Veristrong Industrial Centre  
34-36 Au Pui Wan Street  
Fo Tan, Hong Kong

Attention: Mr. C.L. Lau

Dear Mr. Lau,


**Re: Contract No. CV/2015/07  
Handling of Surplus Public Fill (2016 – 2018)**

**Quarterly EM&A Summary Report No. 1 (from 12 May 2017 to  
31 July 2017) for the Tseung Kwan O Area 137 Fill Bank**

Reference is made to your submission of the draft Quarterly EM&A Summary Report No. 1 (12 May to 31 July 2017) for the TKO Area 137 Fill Bank received by email on 1 September 2017, we are pleased to inform you that we have no comment on the quarterly EM&A summary report.

Thank you for your attention. Please do not hesitate to contact our Jason Lai or the undersigned should you have any queries.

Yours sincerely,  
For and on behalf of  
Ramboll Environ Hong Kong Limited



F. C. Tsang  
Independent Environmental Checker

c.c. CEDD            Attn: Mr. Simon Leung            Fax No.: 2714 0113  
      CHZHJV        Attn: Mr. S W Sung                By Email

Q:\Projects\CEDPFRSFEM02\02 Project Management\02 Corr\CEDPFRSFEM02\_0\_0098L.17.doc

<b>TABLE OF CONTENTS</b>		<b>Page</b>
<b>EXECUTIVE SUMMARY</b>		
<b>1.0</b>	<b>INTRODUCTION</b>	1
<b>2.0</b>	<b>PROJECT INFORMATION</b>	
	2.1 Scope of the Project	1
	2.2 Site Description	2
	2.3 Project Activities	2
	2.4 Project Organization and Management Structure	2
	2.5 Contact Details of Key Personnel	2
<b>3.0</b>	<b>SUMMARY OF EM&amp;A REQUIREMENTS</b>	
	3.1 EM&A Programme	2
	3.2 Monitoring Stations and Parameters	2
	3.3 Monitoring Methodology and Calibration Details	3
	3.4 Environmental Quality Performance Limits (Action/Limit Levels)	3
	3.5 Environmental Mitigation Measures	3
<b>4.0</b>	<b>MONITORING RESULTS</b>	
	4.1 Air Quality	3
	4.2 Noise	4
	4.3 Marine Water Quality	4 – 5
<b>5.0</b>	<b>INSPECTION RESULTS</b>	
	5.1 Inspection Results	5
	5.2 Status of Environmental Licensing and Permitting	5 – 6
	5.3 Advice on Solids and Liquid Waste Management Status	6
<b>6.0</b>	<b>NON-COMPLIANCE OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS</b>	
	6.1 Summary of Non-compliance	6
	6.2 Review of the Reasons for and the implication of non-compliance	6
	6.3 Summary of Action Taken	6
	6.4 Summary of Environmental Complaint, Notification of Summons and Successful	7
<b>7.0</b>	<b>COMMENTS, CONCLUSIONS AND RECOMMENDATION</b>	7 – 8
<b>APPENDIX</b>		
A	Organization Chart and Lines of Communication	
B	Graphical Plots of Impact Air Quality Monitoring Data	
C	Graphical Plots of Impact Noise Monitoring Data	
D	Graphical Plots of Impact Marine Water Quality Monitoring Data	
E	Environmental Quality Performance (Action / Limit Levels)	
F	Event-Action Plans	
G	Project Activities	
H	Implementation Schedule of Environmental Mitigation Measures (EMIS)	
I	Statistical Analysis of the Trend of Suspended Solids in the Quarter	
J	Site General Layout Plan	
K	Weather Condition	
<b>Figures</b>		
Figure 1	Air Quality Environmental Monitoring Stations	
Figure 2	Noise Environmental Monitoring Station	
Figure 3	Locations of Air Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank	



## **Tables**

2.1	Contact Details of Key Personnel
4.1	Summary of Number of Exceedances for 1-hr and 24-hr TSP Monitoring
4.2	Comparison of Baseline and Various Period of Average 1-hr and 24-hr TSP Impact Monitoring Results
4.3	Summary of Impact Monitoring Results of Noise Daytime Monitoring
4.4	Total Number of Marine Water Quality Exceedances in the Quarter
4.5	Summary of Statistically Significant Results of SS
5.1	Summary of Environmental Licensing and Permit Status
5.2	Estimated Offsite Waste Disposal in the Reporting Quarter
6.1	Summary of Environmental Complaints and Prosecutions

## **EXECUTIVE SUMMARY**

This is Quarterly Environmental Monitoring and Audit (EM&A) Summary Report No.1 prepared by ETS-Testconsult Ltd (ET) for the "Contract No: CV/2015/07 – Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O (TKO) Area 137 Fill Bank" (The Project).

This report documents the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 from 12 May 2017 to 31 July 2017.

### **Site Activities**

As informed by the Contractor, the site activities in this reporting quarter were as below:

12 to 31 May 2017	<ol style="list-style-type: none"><li>1. Operation of the TKO137 Fill Bank.</li><li>2. Transferring public fill to vessel and delivering to Taishan and other parties</li><li>3. Construction of site office</li></ol>
June 2017	<ol style="list-style-type: none"><li>1. Operation of the TKO137 Fill Bank.</li><li>2. Transferring public fill to vessel and delivering to Taishan and other parties</li><li>3. Construction of site office</li></ol>
July 2017	<ol style="list-style-type: none"><li>1. Operation of the TKO137 Fill Bank.</li><li>2. Transferring public fill to vessel and delivering to Taishan and other parties.</li></ol>

Dump truck traffic and hauling activities at Barge Handling Area (BHA) were the major dust sources. Barge delivery of fill material was also undertaken in the reporting quarter. Besides the Fill Bank operation, the other dust sources near TKO Area 137 also included operation of C&DMSF and dumping activities at the SENT Landfill.

The desilting facilities were in proper operation to avoid silty discharge and the silt curtains were properly installed. There was no sediment plume observed during the monitoring events.

The major noise sources during the reporting quarter were the dump truck traffic and construction activities near the site egress. Noise impact on the sensitive receivers was insignificant in the reporting quarter according to the results of noise monitoring and site inspections.

### **Environmental Monitoring Works**

#### **Noise Monitoring**

No exceedance of Action and Limit levels for noise monitoring was recorded in the reporting quarter.

#### **Air Monitoring**

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in this quarter.

#### **Marine Water Quality Monitoring**

According to the summary of marine water monitoring results, no exceedance of Action and Limit Levels was recorded in this quarter.

### **Environmental Complaints, Notification of summons and successful prosecutions**

One complaint was received in this quarter. Besides, No notification of summons or successful prosecutions with respect to environmental issues was received in this quarter.

## 1.0 INTRODUCTION

China Harbour – Zhen Hua Joint Venture (CHZH-JV) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the “Contract No: CV/2015/07 – Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O (TKO) Area 137 Fill Bank” (The Project).

In accordance with the Environmental Permit (No.: EP-134/2002/K) (the EP), an EM&A programme should be implemented in accordance with the procedures and requirements in the EM&A Manual of the approved EIA report (Registration No. AEIAR-060/2002). The EM&A programme for this study as stated in Section 2.3.1 of the EM&A Manual covers the following environmental aspects during the establishment, operation and removal phases of the Fill Bank at Tseung Kwan O Area 137:

- *Fugitive Dust;*
- *Noise generation from onsite activities;*
- *Water Quality; and*
- *Landscape and Visual.*

The EM&A programme requires environmental monitoring for air quality, noise and water quality and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- *All monitoring parameters;*
- *Monitoring schedules for the reporting month and forthcoming months;*
- *Action and Limit levels for all environmental parameters;*
- *Event/Action Plans;*
- *Environmental mitigation measures, as recommended in the Project EIA study final report; and*
- *Environmental requirements in contract documents.*

Baseline monitoring was completed in August and September 2002 by MaterialLab. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This quarterly report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 from 12 May 2017 to 31 July 2017.

## 2.0 PROJECT INFORMATION

### 2.1 Scope of the Project

The scale and scope of the Project as stated in the EP include:

- *Site clearance;*
- *Construction of a temporary storm water system;*
- *Stockpiling of 6 million m<sup>3</sup> of public fill;*
- *Setting up two barging points: one at the Tseung Kwan O Basin (TKO Basin) and one at the Construction and Demolition Material Sorting Facility (C&DMSF) for transporting the stockpiled public fill by barges;*
- *Construction and operation of a Construction and Demolition Material Sorting Facility (C&DMSF);*
- *Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin; and*
- *Remove the temporary fill bank.*

## 2.2 Site Description

Tseung Kwan O Area 137 is located at the southern end of Wan Po Road. In the vicinity of the site are other industrial uses such as SENT landfill, TKO Industrial Estate, etc. Both Island Resort and Fullview Garden are also situated at more than 1.8km from the site. Other existing ASRs and NSRs, including resident developments and schools, are located at a further distance away from TKO Area 137.

## 2.3 Work Programme

Details of work programme in this quarter are shown in Appendix G.

## 2.4 Project Organization and Management Structure

The project organization chart is shown in Appendix A.

## 2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Simon Leung, May Lau, James Sze, Phoebe Tang	Engineer's Representative	2762 5555	2714 0113
IEC (Ramboll Environ)	F C Tsang	IEC	3465 2888	3465 2899
Contractor (CHZH-JV)	Michael Cheung	Project Director	2887 8118	2512 0427
ET (ETL)	C. L. Lau	ET Leader	2946 7791	2695 3944

## 3.0 SUMMARY OF EM&A REQUIREMENTS

### 3.1 EM&A Programme

The EM&A programme required environmental monitoring for air quality, noise and marine water quality and environmental site inspections for air quality, noise, marine water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- All monitoring parameters;
- Monitoring schedules for the reporting month and forthcoming months;
- Action and Limit levels for all environmental parameters;
- Event/Action Plans;
- Environmental mitigation measures, as recommended in the Project EIA study final report; and
- Environmental requirements in contract documents.

The advice on implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 5 of the Report.

### 3.2 Monitoring Stations and Parameters

The EM&A Manual designates several locations to monitor environmental impacts in terms of air quality, noise and water quality due to the Project. The description and detailed locations of monitoring stations for air quality, noise and marine water quality are shown in Figures 1, 2 and 3 and relevant sections of this Report.

### 3.3 Monitoring Methodology and Calibration Details

All monitoring works were conducted and monitoring equipment was calibrated in according with the EM&A Manual.

### 3.4 Environmental Quality Performance Limits (Action/Limit Levels)

The environmental quality performance limits, i.e. Action/Limit Levels (AL Levels) were derived from the baseline monitoring results. If the measured environmental quality parameters exceed the AL Levels, the respective action plan will be implemented. The AL Levels for each monitoring parameter are given in Appendix E. The event action plan is given in Appendix F.

### 3.5 Environmental Mitigation Measures

Relevant mitigation measures were recommended in the EM&A Manual for the Contractor to implement. A list of mitigation measures is given in Appendix H.

## 4.0 MONITORING RESULTS

### 4.1 Air Quality

In accordance with the EM&A Manual, 1-hr and 24-hr TSP air quality monitoring were conducted three times and once per six days correspondingly.

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in this quarter. The trend of air quality during the reporting quarter is present in Appendix B. Wind data included wind speed and wind direction were extracted from Tseung Kwan O Station of Hong Kong Observatory and presented in Appendix K.

Major dust sources in the Fill Bank were dump truck traffic and hauling activities at BHA.

Table 4.1 presents the number of exceedances recorded in each month of the reporting quarter. The number of monitoring event included regular monitoring events and additional ones.

Table 4.1 Summary of Number of Exceedances for 1-hr and 24-hr TSP Monitoring

Monitoring Parameter	Level of Exceedance	12 to 31 May 2017	June 2017	July 2017
24-hr TSP	No of monitoring events	3	5	5
	Action Level	0	0	0
	Limit Level	0	0	0
1-hr TSP	No of monitoring events	12	15	16
	Action Level	0	0	0
	Limit Level	0	0	0

Table 4.2 presents the 1-hr and 24-hr TSP averages in the baseline period and for each month in the reporting quarter. It was found that the 1-hr TSP averages at both stations in the reporting quarter were higher than the baseline levels but they were within the AL Levels. Besides, the 24-hr TSP average results were below the baseline level and within the AL Levels. As a result, the Contractor should provide more mitigation measures refer to the EM&A Manual to avoid dust generation.

Table 4.2 Comparison of Baseline and Various Period of Averaged 1-hr and 24-hr TSP Impact monitoring Results

Period	1-hr TSP ( $\mu\text{g}/\text{m}^3$ )		24-hr TSP ( $\mu\text{g}/\text{m}^3$ )	
	TKO-A1	TKO-A2a	TKO-A1	TKO-A2a
Baseline (29/08 – 13/09)	195		123	
12 to 31 May 2017	70	78	196	225
June 2017	69	75	185	212
July 2017	69	77	185	214



## 4.2 Noise

Noise monitoring was required to be conducted at least once per month. Only daytime noise was monitored in the reporting quarter.

All recorded noise levels complied with the AL Levels. The registered noise levels in the past three months are plotted in Appendices C. Table 4.3 presents the limited level and average impact noise monitoring results during the reporting quarter.

Table 4.3 Summary of Impact Monitoring results of Noise Daytime Monitoring

Monitoring Location	Limit Level	12 to 31 May 2017	June 2017	July 2017
		Leq, dB(A)		
TKO-N1	75	70.3	70.8	61.4

The major noise sources in the reporting quarter were dump truck traffic and construction activities near the site egress. The noise impact was insignificant as the Fill Bank was remote from sensitive receivers.

## 4.3 Marine Water Quality

In accordance with the EM&A Manual, the marine water quality monitoring was conducted at the monitoring station (M4) and the control station (C1) in the reporting quarter.

Impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-ebb and mid-flood tides at three depths (i.e. 1m below surface, mid depth and 1m above seabed). The AL Levels are included in Appendix E.

Table 4.4 presents the total number of marine water quality exceedances in the reporting quarter. The trend of marine water quality in the past three months is depicted in Appendix D.

Table 4.4 Total Number of Marine Water Quality Exceedances in the Quarter

Parameter	Exceedance Level	12 to 31 May 2017	June 2017	July 2017
Number of monitoring days		9	12	13
Dissolved Oxygen, DO (S&M)	Action	0	0	0
	Limit	0	0	0
Dissolved Oxygen, DO (B)	Action	0	0	0
	Limit	0	0	0
Turbidity	Action	0	0	0
	Limit	0	0	0
Suspended Solids, SS	Action	0	0	0
	Limit	0	0	0
Total Number Exceedances	Action	0	0	0
	Limit	0	0	0

A comparison between the quarterly mean/median of SS and the 1.3 times of the baseline mean was made for each tide at each station. The statistical analysis results are given in Appendix I and it shows that a generally better marine quality was recorded in the reporting quarter in respect to 130% of the baseline mean. Monitoring stations with significant difference ( $p < 0.05$ ) is summarized in Table 4.5.

Table 4.5 Summary of Statistically Significant Results of SS

Monitoring Station	Significant difference?	
	Mid-ebb	Mid-flood
C1	X	X
M4	X	X

## 5.0 INSPECTION RESULTS

### 5.1 Implementation Status of Environmental Mitigation Measures

ET conducted weekly site inspections to monitor the Contractor's implementation of environmental mitigation measures. After each site inspection, the Contractor was notified of ET's observations and recommendations. A corrective action plan detailing the environmental observations was prepared by ET and the Contractor then completed this plan to propose/report their remedial works.

Air quality was the major environmental issue in the reporting quarter. The Contractor generally implemented most of the environmental mitigation measures in the reporting quarter. Dump truck traffic was the major dust source in the Fill Bank. Generally, the Contractor implemented adequate dust mitigation measures in the reporting quarter including dampening of haul roads, water spraying on the truckloads, operation of automatic wheel washing facilities and mist spraying systems, dampening of fill material prior to handling or stockpiling, etc.

Dump truck traffic and construction activities near the site egress were the major noise sources. As the Fill Bank was remote from the nearby NSRs, the noise impact was minimal. The powered mechanical equipment were generally operated and maintained properly.

Regarding the observations about accumulation of fill materials on the concrete pavement at the BHA in the reporting quarter, the Contractor was reminded to clean up the fill materials as soon as each unloading activity completed to avoid the fill materials from being washed into the sea. Furthermore, the Contractor should also regularly inspect and maintain the oil interceptor at the car park to ensure it properly functions.

Although there were a few observations regarding improper handling of oil drums and chemical containers, such as lack of drip tray and accumulated of stagnant water in the drip tray, the Contractor rectified most of these problems. Besides, the Contractor should provide tarpaulin sheets before repairing and maintenance works and also carried out proper cleaning activities immediately after such works.

The germination rate on the panel was satisfactory in this reporting quarter. The Contractor was reminded to maintain the panel properly.

### 5.2 Status of Environmental Licensing and Permitting

The status of licences and permits is summarized in Table 5.1.

Table 5.1 Summary of environmental licensing and permit status

Description	Permit No.	Valid Month		Section
		From	To	
Amended Environmental Permit	EP-134/2002/K	04/02/13	---	<ul style="list-style-type: none"> <li>▪ Site clearance</li> <li>▪ Construction of a temporary storm water system</li> <li>▪ Stockpiling of 6 million m<sup>3</sup> of public fill</li> <li>▪ Setting up two barging points for transporting the stockpiled public fill by barges</li> <li>▪ Setting up a temporary barging point at the existing Explosive Off-loading Barging Point for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge</li> <li>▪ Construction of operation of a construction and Demolition Material Sorting Facility (C&amp;DMSF)</li> <li>▪ Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin</li> </ul>
Chemical Waste Producer	5919-839-C4181-01	19/04/17	---	Spent battery cell containing heavy metals and spent lubricating oil

Description	Permit No.	Valid Month		Section
		From	To	
Marine Dumping Permit	EP/MD/18-004	19/05/17	30/06/17	Approval for dumping 1,700,000 tons (approximately equal to 944,444 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan
Marine Dumping Permit	EP/MD/18-021	08/07/17	30/09/17	Approval for dumping 3,000,000 tons (approximately equal to 1,666,667 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan
Billing Account for Waste Disposal	7027643	22/05/17	---	---
Notification Pursuant to Section 3(1) of the Air Pollution Control (Construction Dust)	415682	12/04/17	---	---
Discharge License	Applied on 23 May 2017			

### 5.3 Advice on Solids and Liquid Waste Management Status

The Contractor usually disposed of non-inert waste, including general refuse and materials segregated from the existing stockpiles, to SENT landfill. Table 5.2 summarizes data on offsite waste disposal in the quarter.

Table 5.2 Estimated Offsite Waste Disposal in the Reporting Quarter

Waste Type	12 to 31 May 2017	June 2017	July 2017
Public Fill (m <sup>3</sup> )	0	0	0
C&D Waste (general refuse) (kg)	0	0	36.89
Chemical Waste (kg/L)	0	0	0

The site toilet and shower room and several chemical toilets were in use throughout the reporting quarter. Discharge from the site toilet and shower room was made to the additional drainage DP4 after passing through the sewage treatment system. A licensed collector also regularly collected waste from the chemical toilets.

## 6.0 NON-COMPLIANCE OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS

### 6.1 Summary of Non-compliance

In this reporting quarter, no exceedance of Action and limit levels on marine water quality was recorded.

No exceedances on 1-hour and 24-hour TSP monitoring results were recorded in this quarter.

Besides, no day-time noise level measured at the monitoring station exceeded the Action and Limit Level in this quarter.

### 6.2 Review of the Reasons for and the Implications of Non-compliance

Since there was no exceedance recorded in this quarter, the review of the reasons for the non-compliance was not required.

### 6.3 Summary of Actions Taken

Since there was no exceedance recorded in this quarter, no further action was not required to be taken.

### 6.4 Summary of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

One complaint was received in this quarter. Besides, no notification of summon and successful prosecution was received in this quarter.

A summary of environmental complaints and prosecutions was given in Table 6.1.

Table 6.1 Summary of Environmental Complaints and Prosecutions

<i>Period</i>	<i>Complaints logged</i>	<i>Summon served</i>	<i>Successful Prosecution</i>
<i>12 to 31 May 2017</i>	<i>1</i>	<i>0</i>	<i>0</i>
<i>June 2017</i>	<i>0</i>	<i>0</i>	<i>0</i>
<i>July 2017</i>	<i>0</i>	<i>0</i>	<i>0</i>
<i>Cumulative</i>	<i>1</i>	<i>0</i>	<i>0</i>

## 7.0 COMMENTS, CONCLUSIONS AND RECOMMENDATION

In this quarter, major activity in the Fill Bank was the import and dumping of fill material. Air quality was the major environmental issue in the Fill Bank. Generally, the Contractor implemented most of the mitigation measures to minimize the dust impact.

No exceedance of Action and Limit levels was recorded for 1-hour and 24-hour TSP monitoring in this quarter.

No exceedance of Action and Limit Level of noise was recorded in this reporting quarter.

No exceedance of Action and limit level on marine water quality was recorded in this quarter.

One complaint was received in this quarter. Besides, no notification of summon and successful prosecution was received in this quarter.

According to the ET weekly site inspection and IEC site audits carried out in this quarter, it was indicated that site practices of the Contractor were generally undertaken in an environmentally acceptable manner and the overall site environmental performance was up to standard. The Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

According to the environmental site inspections performed in this quarter, the following recommendations were provided:

#### **Air Quality**

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water boswer;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the site activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

**Noise**

- Conduct noisy activities at a farther location from the NSRs.

**Water Quality**

- Maintain the drainage system, including the trapezoidal channels, permanent desilting chambers, DP3 & DP4 regularly;
- Operate and maintain the silt curtains regularly;
- Operate the cleaning vessel within the TKO Basin regularly;
- Provide proper treatment for the oil discharge from the area near air monitoring station TKO-A1;
- Clean up the fill material on the concrete pavement at BHA frequently; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

**Chemical and Waste Management**

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain mesh screen on top of the additional drainage, DP3 to avoid improper dumping of rubbish;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.

**Landscape and Visual**

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeding slopes in accordance with the Landscape Plan.

- END OF REPORT -

## Appendix

### A

#### Organization Chart

JOINT VENTURE MANAGEMENT BOARD  
WANG Yan, CHEUNG Chi Yuen, Michael


Project Director  
CHEUNG Chi Yuen, Michael

Senior Project Manager  
ZHOU Cheng Ying

Senior Project Engineer  
ZHOU Cheng Ying




CONSTRUCTION & OPERATION TEAM

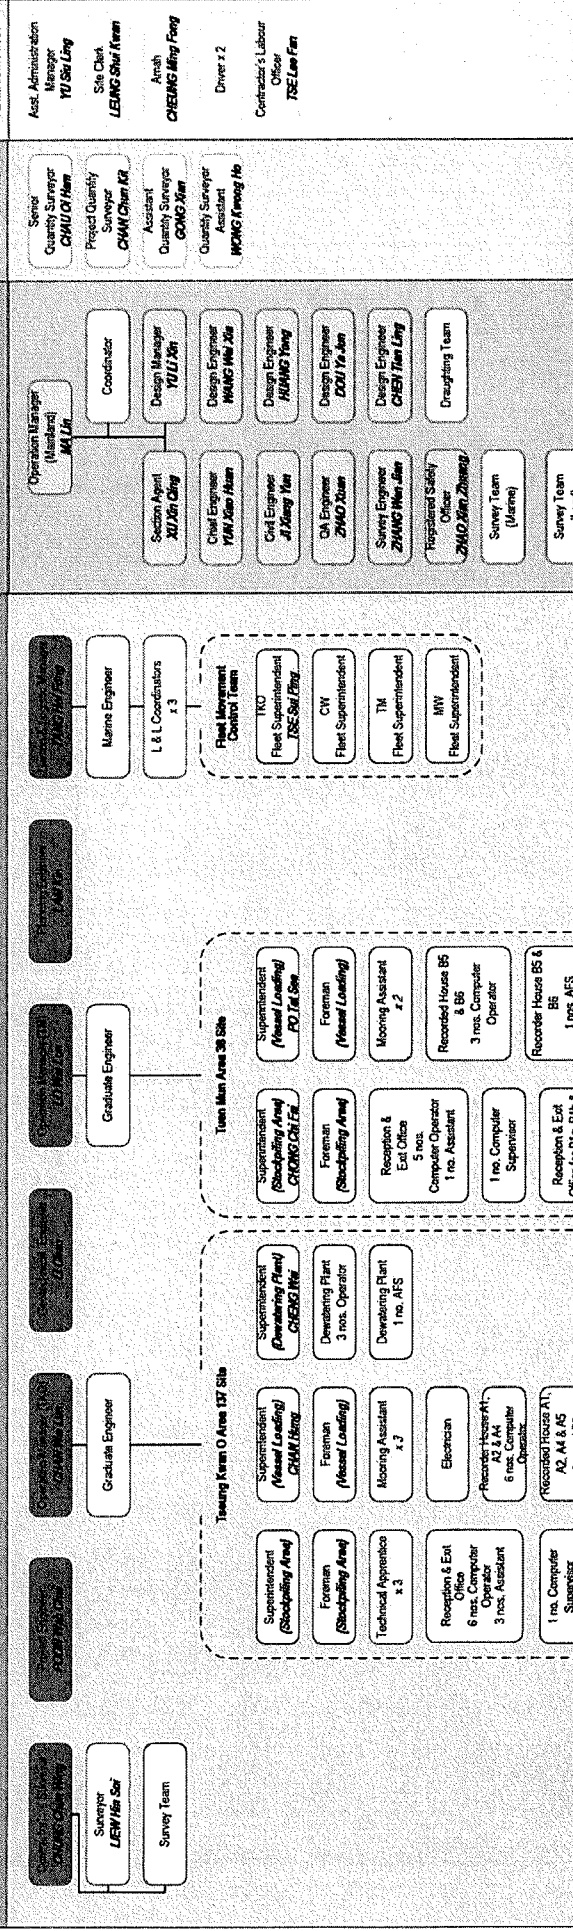

**LABOUR**

TKO	Tseung Kwan O Area 137 Fill Bank
TM	Tuen Mun Area 38 Fill Bank

Top Management
Professional
Technical Staff with Mainland Experience

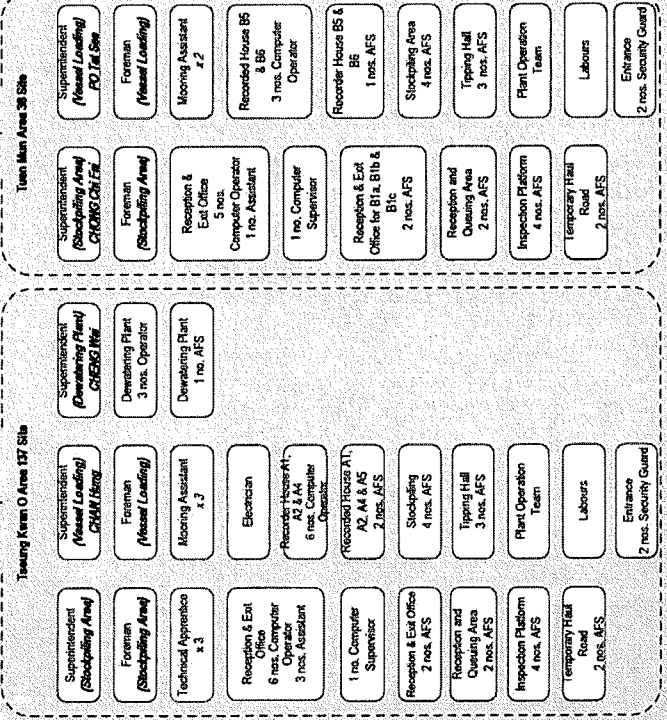

## **Appendix**


### **B**

## **Graphical Plots of Air Quality Monitoring Data**






### 1-hour TSP level at TKO-A1

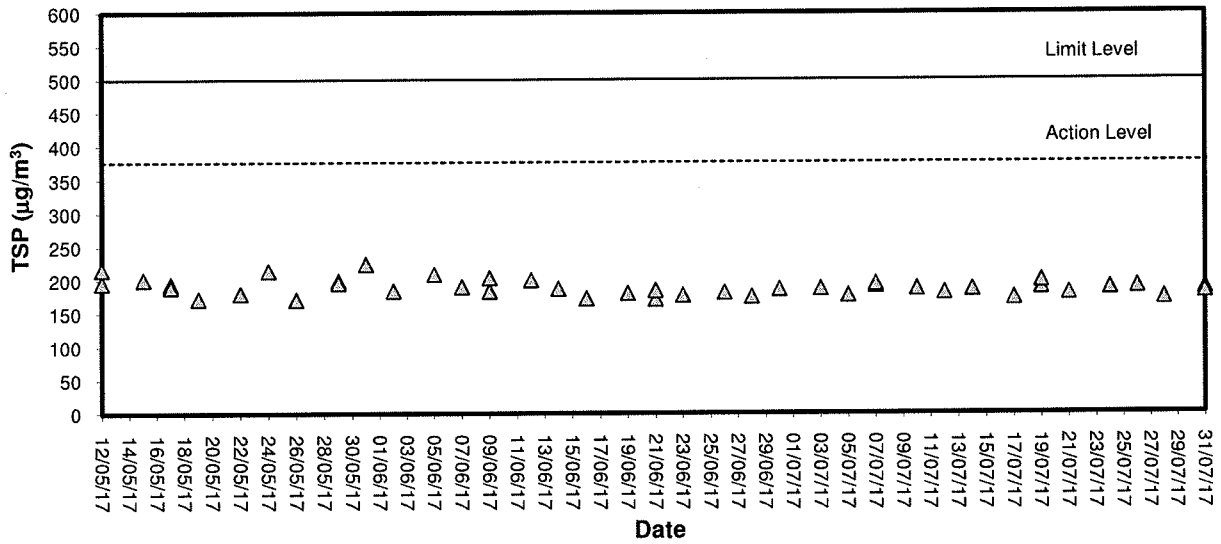


### 1-hour TSP level at TKO-A2a

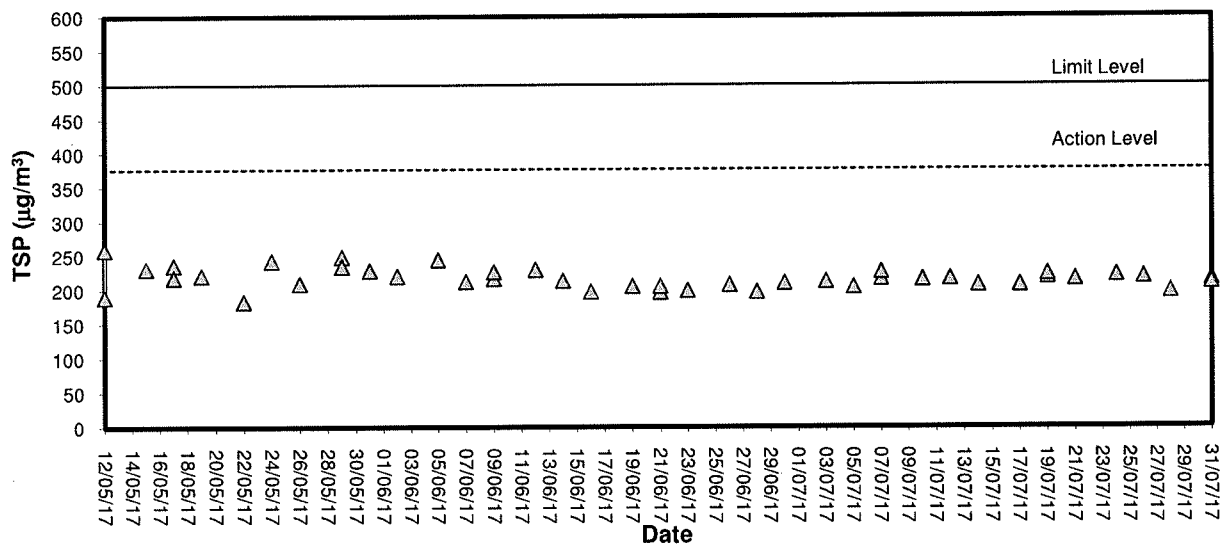




### 24-hour TSP level at TKO-A1

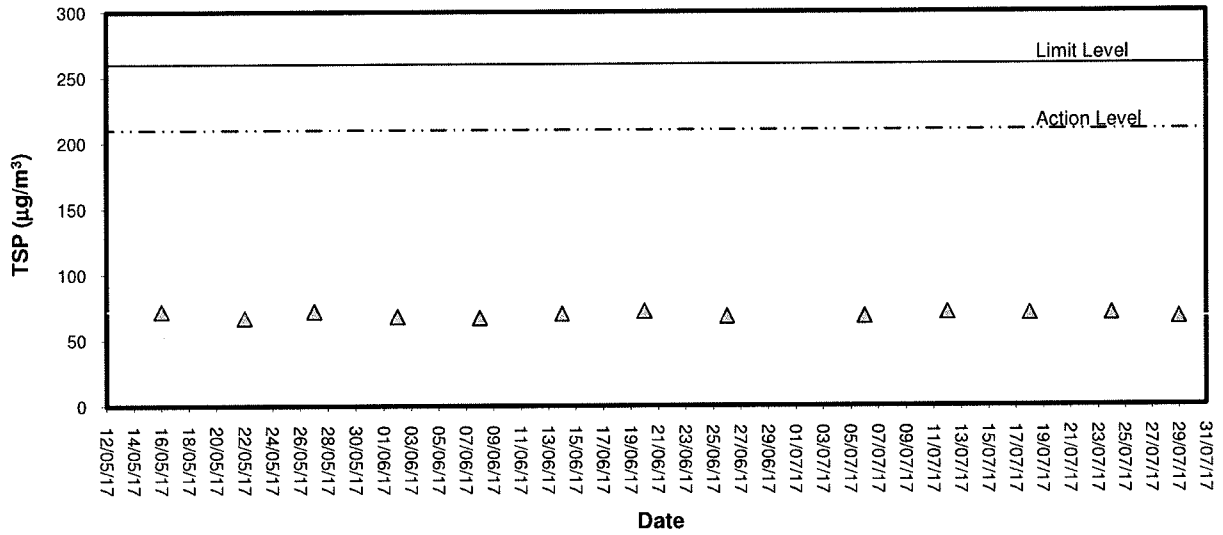

### 24-hour TSP level at TKO-A2a

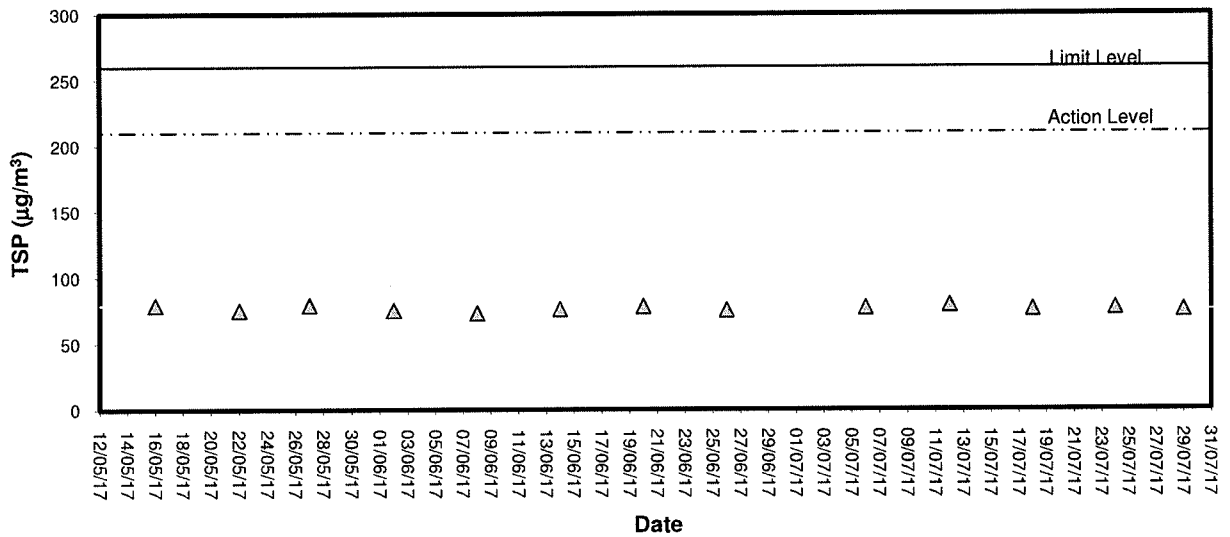


## **Appendix**

### **C**

#### **Graphical Plots of Noise Monitoring Data**



## Noise Monitoring (Day-time)

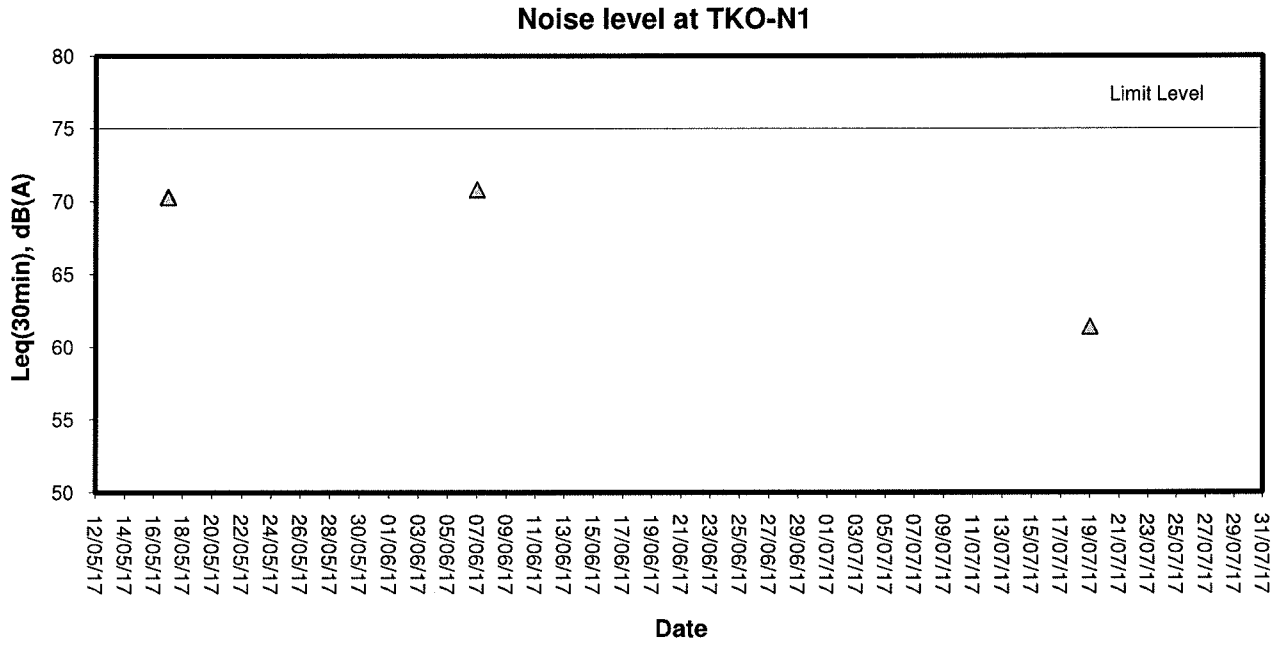


## **Appendix**


### **D**

#### **Graphical Plots of Impact Marine Water Quality Monitoring Data**


**Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide**

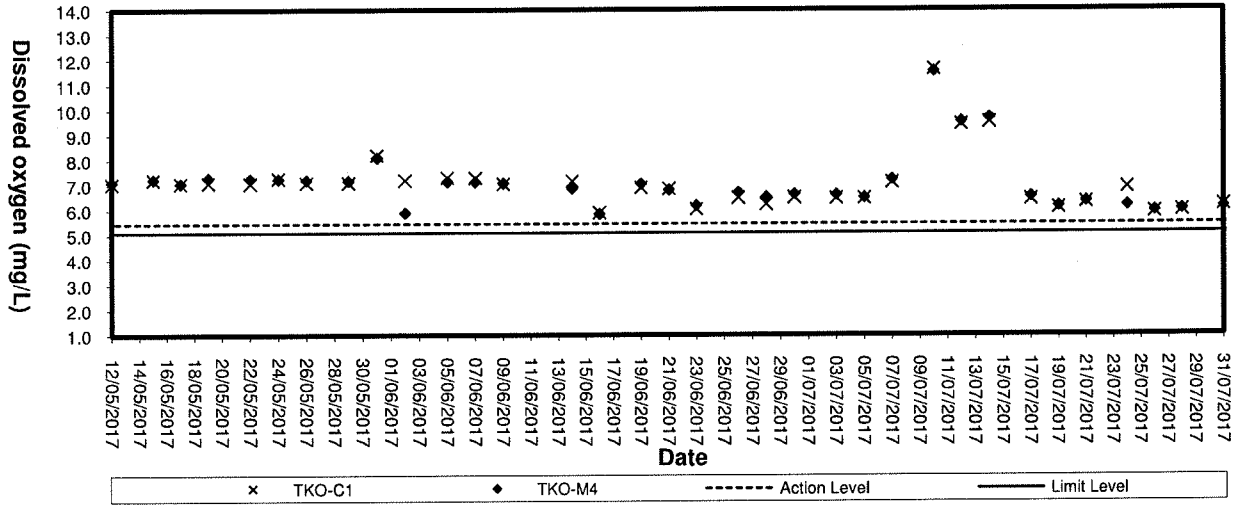


**Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide**

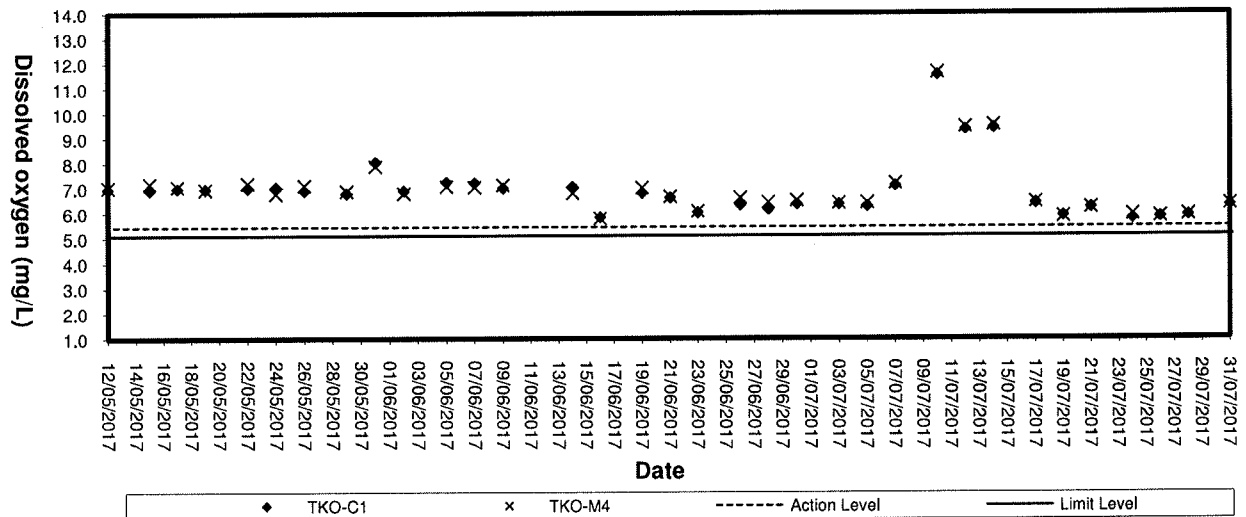


**Dissolved Oxygen (Bottom) at Mid-Flood Tide**

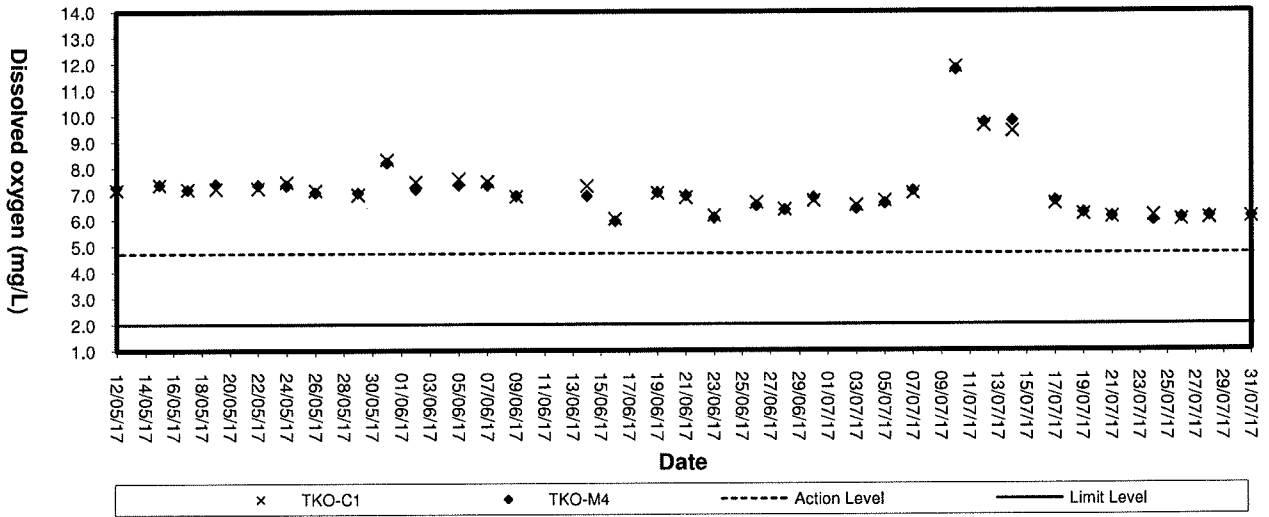


**Dissolved Oxygen (Bottom) at Mid-Ebb Tide**

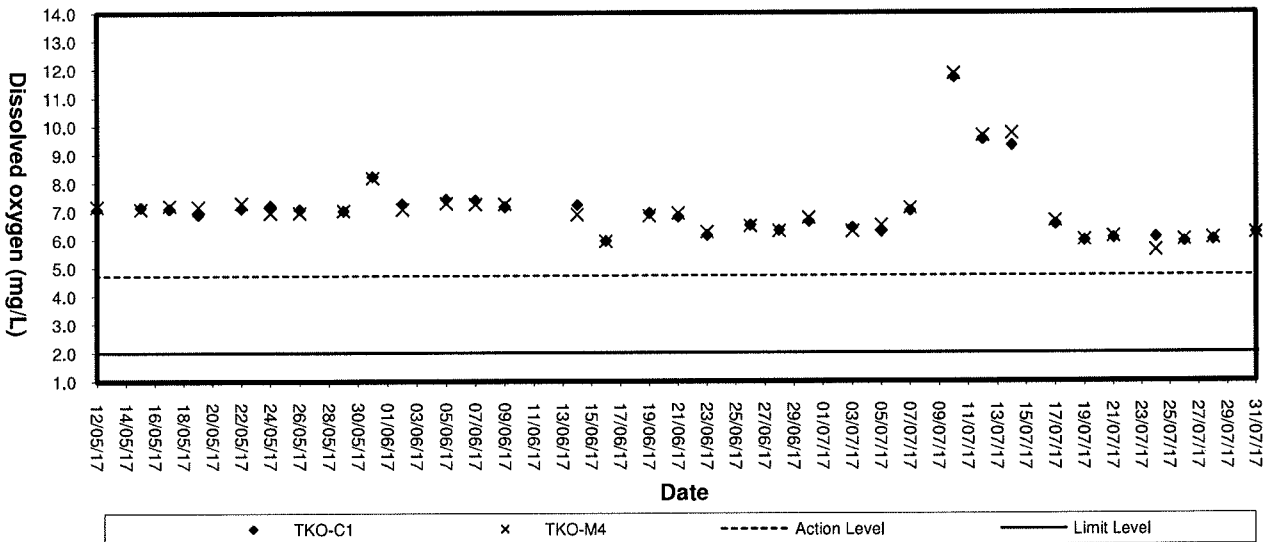

**Turbidity (Depth-average) at Mid-Flood Tide**

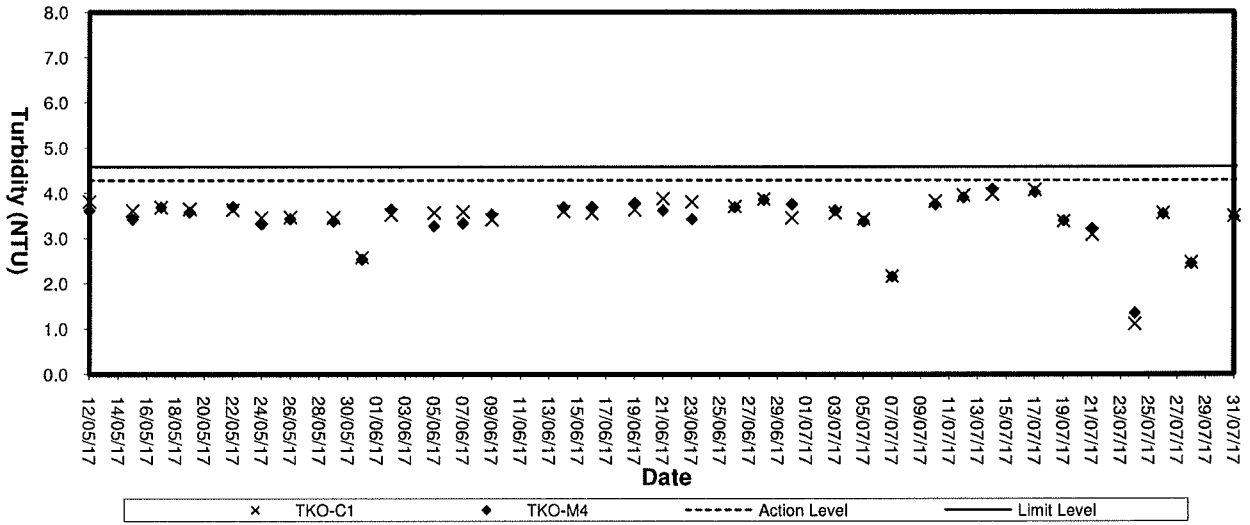


**Turbidity(Depth-average) at Mid-Ebb Tide**

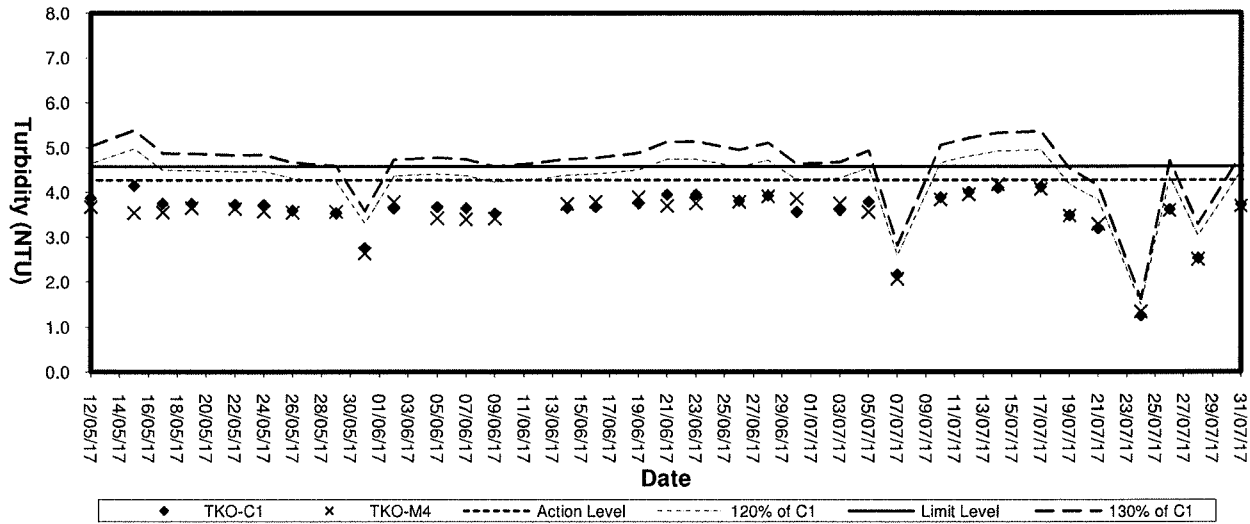




**Suspended solids (Depth-average) at Mid-Flood Tide**

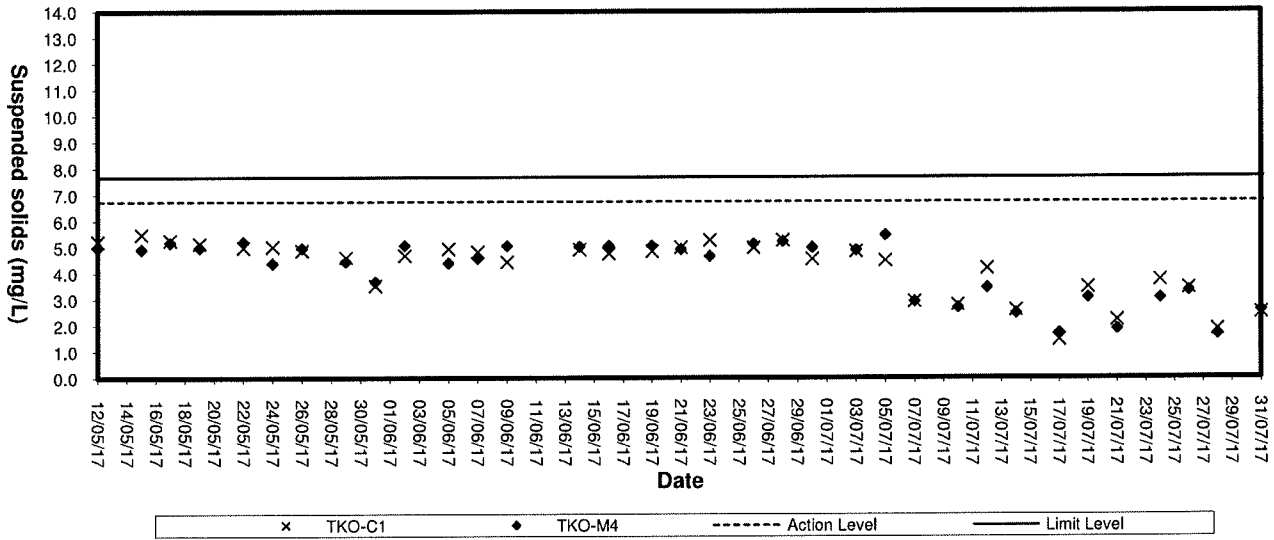

**Suspended Solids (Depth-average) at Mid-Ebb Tide**

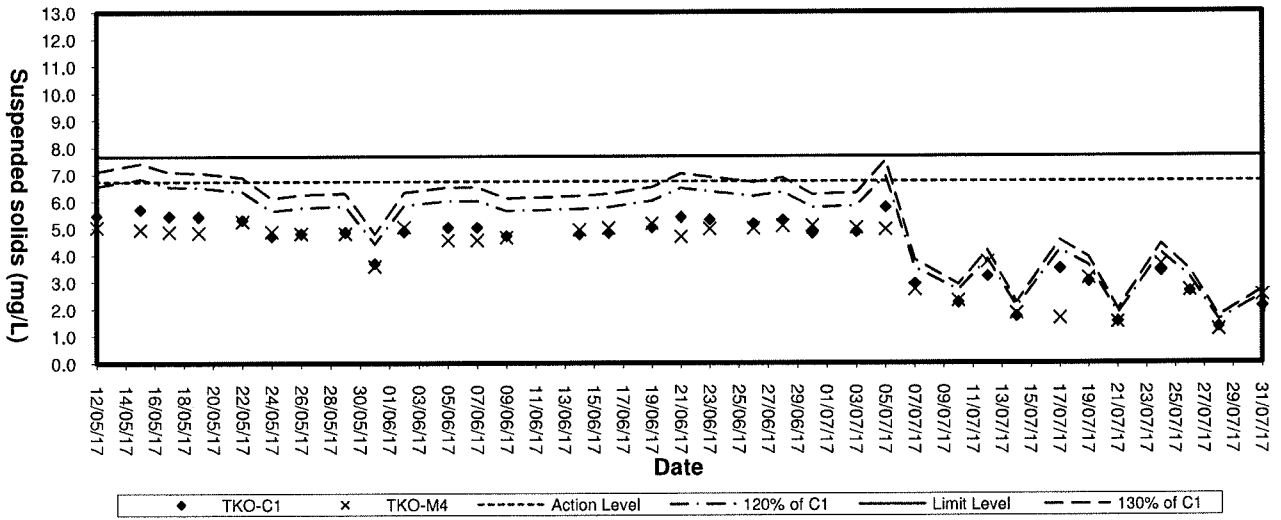

## Appendix

### E

#### Environmental Quality Performance (Action / Limit Levels)

**Action and Limit Levels for Air Quality**

**Action and Limit Levels for 1-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
A1	376	500
A2		

**Action and Limit Levels for 24-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
A1	210	260
A2		

**Action and Limit Levels for Noise**

Time Period	Action	Limit
0900-2100 hrs on all days	When one documented complaint is received	75*dB(A)

**Action and Limit Levels for Water Quality**

Parameters	Action	Limit
Dissolved oxygen, DO mg/L (Surface, Middle & Bottom)	<u>Surface &amp; Middle</u> DO < 5.45 (5%-ile of baseline data) <u>Bottom</u> DO < 4.72 (5%-ile of baseline data)	<u>Surface &amp; Middle</u> DO < 5.10 (1%-ile of baseline data) <u>Bottom</u> 2 mg/L
Suspended solids, SS mg/L (Depth-averaged)	SS > 6.74 (95%-ile of baseline data or SS > 120% of upstream control stations SS at the same tide of the same day)	SS > 7.67 (99%-ile of baseline data or SS > 130% of upstream control stations SS at the same tide of the same day)
Turbidity, Tby NTU (Depth-averaged)	Tby > 4.28 (95%-ile of baseline data or Tby > 120% of upstream control stations Tby at the same tide of the same day)	Tby > 4.58 (99%-ile of baseline data or Tby > 130% of upstream control stations Tby at the same tide of the same day)

## **Appendix**

### **F**

#### **Event-Action Plans**

## EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

### ACTION

	ET Leader	IC(E)	ER	Contractor
	<b>ACTION LEVEL</b>			
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Inform ER, IC(E) and Contractor</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET</li> <li>2. Check contractor's working method</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify Contractor</li> </ol>	<ol style="list-style-type: none"> <li>1. Rectify any unacceptable practise</li> <li>2. Amend working methods if appropriate</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Inform IC(E) and Contractor</li> <li>3. Repeat measurements to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Discuss with IC(E) and Contractor on remedial actions</li> <li>6. If exceedance continues, arrange meeting with IC(E) and ER.</li> <li>7. If exceedance stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET Leader</li> <li>2. Check the Contractor's working method</li> <li>3. Discuss with ET and Contractor on possible remedial measures</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures</li> <li>5. Supervise implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify the Contractor</li> <li>3. Ensure remedial measures properly implemented</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>2. Implement the agreed proposals</li> <li>3. Amend proposal if appropriate</li> </ol>
	<b>LIMIT LEVEL</b>			
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Inform ER, Contractor and EPD</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET Leader</li> <li>2. Check Contractor's working method</li> <li>3. Discuss with ET and Contractor on possible remedial measures</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures</li> <li>5. Supervise implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify the Contractor</li> <li>3. Ensure remedial measures properly implemented</li> </ol>	<ol style="list-style-type: none"> <li>1. Take Immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Amend proposal if appropriate.</li> </ol>

## EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ACTION			Contractor
	ET Leader	IC(E)	ER	
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Notify IC(E), ER, EPD and Contractor</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented</li> <li>6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> <li>8. If exceedance stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET and Contractor on the potential remedial actions</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly</li> <li>3. Supervise the implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify Contractor</li> <li>3. In consultation with the Contractor on agree with the Contractor on the remedial measures to be implemented</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedances</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Resubmit proposals if problem still not under control</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedance is abated</li> </ol>

## EVENT/ACTION PLAN FOR NOISE EXCEEDANCE

EVENT	ACTION			
	ET Leader	IC(E)	ER	Contractor
Action Level	<ol style="list-style-type: none"> <li>1. Notify the IC(E) and the Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to the IC(E) and the Contractor.</li> <li>4. Discuss with the Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IC(E).</li> <li>2. Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol style="list-style-type: none"> <li>1. Notify the IC(E), the ER, the EPD and the Contractor.</li> <li>2. Identify source.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform the IC(E), the ER and the EPD the causes &amp; actions taken for the exceedances.</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results</li> <li>8. If exceedance due to the construction works stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Resubmit proposals if problem still not under control.</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			
	ET Leader	Contractor	ER	IEC
Action level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Repeat in-situ measurement to confirm findings;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days</li> <li>8. Repeat measurement on next day of exceedance if exceedance is due to the construction works</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify the ER and IEC in writing within 24 hours of identification of exceedance</li> <li>2. Check all plant and equipment;</li> <li>3. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance</li> <li>5. Consider changes of working method if exceedance is due to the construction works</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the mitigation measure</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures</li> <li>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>5. Supervise the implementation of mitigation measures</li> </ol>



## EVENT AND ACTION PLAN FOR WATER QUALITY

Event	ACTION			
	ET Leader	Contractor	ER	IEC
<p>Action level being exceeded by more than one consecutive sampling days</p>	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Repeat in-situ measurement to confirm findings</li> <li>3. Notify Contractor in writing within 24 hours of identification</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Prepare to increase the monitoring frequency to daily;</li> <li>10. Repeat measurement on next day of exceedance.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify IEC and ER in writing within 24 hours of identification of exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the mitigation measure</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

### ACTION

Event	ET Leader	Contractor	ER	IEC
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC, ER and Contractor within 4 working of identification of an exceedance</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Increase the monitoring frequency to daily until no exceedance of Limit Level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify IEC and ER in writing; within 24 hours of the identification of the exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to critically review the working methods;</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>5. Assess the effectiveness of the implemented mitigation measures</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			
	ET Leader	Contractor	ER	IEC
Limit Level being exceeded by more than one consecutive sampling days	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC, ER and Contractor;</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify ER and IEC in writing within 24 hours of the identification of the exceedance and Rectify unacceptable practice;</li> <li>2. Check all plant and equipment;</li> <li>3. Consider changes of working methods;</li> <li>4. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days;</li> <li>6. Implement the agreed mitigation measures within reasonable time scale</li> <li>7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to critically review the working methods;</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the implemented mitigation measures;</li> <li>6. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ER, ET and Contractor on the mitigation measures.</li> <li>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>

## **Appendix**

### **G**

## **Work Programme**

China Harbour - Zhen Hua Joint Venture  
 Contract No. CV/2015/07  
 Handling of Surplus Public Fill (2016-2018)

Three Months Rolling Programme (1-May-2017 to 31-August-2017)

Item	Description	From	To	May-17																															Jun-17																															Jul-17																															Aug-17																														
				1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31
1	Section 1	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
1.1	Take over existing site facilities	11-May-17	11-May-17	[Gantt bar]																																																																																																																											
1.2	Operation of Fill Bank, surveillance system and tipping balls	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
1.3	Design, provision and operation of crushing plant	25-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
1.4	Design and refurbishment of 2 nos. of tipping balls	8-Jun-17	31-Aug-17	[Gantt bar]																																																																																																																											
1.5	Collection and delivery of Public Fill from CWPFBP and MWPRF to TKQFB	15-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
1.6	Design, provision and operation of the expanded de-watering plant	19-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
1.7	Planning and removal of Public Fill at Portion A6	25-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
2	Section 2	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
2.1	Take over existing site facilities	11-May-17	11-May-17	[Gantt bar]																																																																																																																											
2.2	Operation of Fill Bank, surveillance system and tipping balls	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
2.3	Design and construction of 750mm U-channel and catwalks	25-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
2.4	Design, construction and operation of New Secondary Site Office for the Engineer	17-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
2.5	Planning and replacement of 5 nos. of weighbridges at CREO	1-Jun-17	31-Aug-17	[Gantt bar]																																																																																																																											
2.6	Design and refurbishment of 2 nos. of tipping balls	25-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
3	Section 3	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
3.1	Design and construction of earwalls at Zone B (approx. 900m) and at Zone C (approx. 2000m)	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
4	Section 3A	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
4.1	Design, construction and operation of new berthing facilities at Zone B	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
4.2	Design, construction and operation of new navigation channel and turning basin (interoperated with the berthing facilities at Zone B)	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
4.3	Design and construction of berths at Zone B (approx. 1500m)	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
5	Section 4	11-May-17	31-Aug-17	[Gantt bar]																																																																																																																											
5.1	Collection and delivery of Public Fill to the Designated Reclamation Sites in the Ad.	15-May-17	31-Aug-17	[Gantt bar]																																																																																																																											

## Appendix

### H

## Implementation Schedule of Environmental Mitigation Measures (EMIS)

## Environmental Mitigation Implementation Schedule

	Location	Implementation Status		
		Implemented	Partially implemented	Not implemented
<b>Environmental Protection Measures</b>				
<b>Air Quality</b>				
• Dust control / mitigation measures shall be provided to prevent dust nuisance.	All areas	√		
• A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	Northern Site Boundary	√		
• Water sprays shall be provided and used to dampen materials.	All areas	√		
• Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	All areas	√		
• All vehicles shall be restrict to a maximum speed of 10 km per hour.	All areas	√		
• Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	Site Egress	√		
• The designated site main haul rout shall be paved or regular watering.	All haul roads		√	
• Frequent watering of work site shall be at least three times per day.	All areas	√		
• Wheel washing facilities including high pressure water jet shall be provided at the entrance of work site.	Site Egress	√		
• Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	Site Egress	√		
• The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	All areas	√		
• Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	All areas	√		
• When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	C&DMFS			√
• The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	C&DMFS			√
• The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	C&DMFS			√
• All plant and equipment should be well maintained e.g. without black smoke emission.		√		
<b>Noise Impact</b>				
• Approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	All areas	√		
• Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	All areas	√		
• Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	All areas	√		
• Air compressors and hand held breakers should have noise labels.	All areas	√		
• Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	All areas	√		
• Noisy equipment and mobile plant shall always be site away from NSRs.	All areas	√		

	Location	Implementation Status			
		Implemented	Partially implemented	Not implemented	Not Applicable
<b>Environmental Protection Measures</b>					
<b>Water Quality</b>					
<ul style="list-style-type: none"> <li>▪ Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.</li> <li>▪ The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.</li> <li>▪ Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.</li> <li>▪ Manholes should be covered and sealed.</li> <li>▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.</li> <li>▪ A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.</li> <li>▪ A buffer distance of at least 20m shall be maintained between the boundary of the C&amp;DMSF and the seafront.</li> <li>▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.</li> <li>▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> <li>▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> <li>▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.</li> <li>▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.</li> <li>▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.</li> <li>▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.</li> <li>▪ Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas and work shop.</li> <li>▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.</li> <li>▪ The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.</li> <li>▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.</li> <li>▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.</li> <li>▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.</li> <li>▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.</li> <li>▪ Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.</li> <li>▪ A waste collection vessel shall be deployed to remove floating debris.</li> </ul>	All areas	√			
	All areas	√			
	All areas	√			
	All areas	√			
	All areas	√			
	Public fill stockpiling area	√			
	C&DMSF	√			
	All areas	√			
	Temporary Slopes	√			
	Temporary Slopes	√			
	All areas		√		
	Wheel Washing facility	√			
	Wheel Washing facility	√			
	All areas	√			
	All areas	√			
	Barge Handling Area (BHA)	√			
	Barge Handling Area (BHA)	√			
	Barge Handling Area (BHA)	√			
	Along the seafront	√			
	Barge Handling Area (BHA)	√			
	Along the seafront		√		
	Along the seafront		√		
	Along the seafront	√			



Environmental Protection Measures	Location	Implementation Status			
		Implemented	Partially implemented	Not implemented	Not Applicable
<b>Landscape and Visual</b>					
• Construction of lighting to avoid spillage and glare	All areas	√			
• Hydroseeding	Completed slopes	√			
• Hoarding erection	Site boundary	√			
• Damage to surrounding area avoided	All areas	√			
<b>Other Environmental Factors</b>					
• C&D waste sorted from mixed C&D material shall be transfer to SENT landfill for disposal.	All areas	√			
• Plan and stock construction materials carefully to minimise generation of waste.	All areas	√			
• Any unused materials or those with remaining functional capacity should be recycled.	All areas	√			
• All generators, fuel and oil storage are within bunded areas.	All areas	√			
• Oil leakage from machinery, vehicle and plant is prevented.	All areas	√			
• Bund chemical storage area to 110% capacity.	All areas	√			
• Prevent disposal of hazardous materials to air, soil and water body	All areas	√			
• Provide rubbish skips at all work areas	All areas	√			
• Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	All areas		√		
• To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	All areas	√			

## Appendix

### I

## Statistical Analysis of the Trend of Suspended Solids in the Quarter

## Statistical Analysis of the Trend of Suspended Solids

### For Mid-Flood Tide

#### Station: M4

#### t-test

Group Name	N	Missing	Mean	Std Dev	SE
130% Baseline Mean	12	0	6.969	1.069	0.3086
Quarterly Mean	34	0	4.1457	1.1691	0.2005

#### Result:

Probability that two variances are equal (f-test) = 0.60673

Difference between means = 2.8233 (Std Dev = 1.6864 and SE = 0.368)  
(95% CI :2.102 < Diff < 3.5446)

t-value of difference = 7.672 (20.5 degrees of freedom)  
P = 1 (>0.05)

#### Conclusion:

There is no statistically significant difference between the groups.

#### Station: C1

#### t-test

Group Name	N	Missing	Mean	Std Dev	SE
130% Baseline Mean	12	0	6.969	0.950	0.2742
Quarterly Mean	34	0	4.2002	1.1167	0.1915

#### Result:

Probability that two variances are equal (f-test) = 0.70805

Difference between means = 2.7688 (Std Dev = 1.5886 and SE = 0.3345)  
(95% CI : 2.1132 < Diff < 3.4244)

t-value of difference = 8.278 (22.1 degrees of freedom)  
P = 1 (>0.05)

#### Conclusion:

There is no statistically significant difference between the groups.

## Statistical Analysis of the Trend of Suspended Solids

### For Mid-Ebb Tide

#### Station: M4

#### t-test

Group Name	N	Missing	Mean	Std Dev	SE
130% Baseline Mean	12	0	6.897	1.449	0.4183
Quarterly Mean	34	0	4.0735	1.2628	0.2166

#### Result:

Probability that two variances are equal (f-test) = 0.25903

Difference between means = 2.8235 (Std Dev = 1.9577 and SE = 0.471)  
(95% CI : 1.9003 < Diff < 3.7467)

t-value of difference = 5.994 (16.8 degrees of freedom)  
P = 1 (>0.05)

#### Conclusion:

There is no statistically significant difference between the groups.

#### Station: C1

#### t-test

Group Name	N	Missing	Mean	Std Dev	SE
130% Baseline Mean	12	0	6.933	1.045	0.3017
Quarterly Mean	34	0	4.2245	1.3315	0.2284

#### Result:

Probability that two variances are equal (f-test) = 0.80187

Difference between means = 2.7085 (Std Dev = 1.874 and SE = 0.3783)  
(95% CI : 1.967 < Diff < 3.45)

t-value of difference = 7.159 (24 degrees of freedom)  
P = 1 (>0.05)

#### Conclusion:

There is no statistically significant difference between the groups.

## **Appendix**

### **J**

#### **Site General Layout plan**

**NOTES:**

- ALL DIMENSIONS REFER TO HONG KONG METRIC UNITS UNLESS SPECIFIED OTHERWISE.
- ALL LEVELS REFER TO HONG KONG PRINCIPAL DATUM (H.K.P.M.) UNLESS OTHERWISE SPECIFIED.





**LEGEND:**

- SITE BOUNDARY
- PORTION BOUNDARY (INDICATIVE ONLY)
- PORTION A2 OF THE PORTION 1
- PORTION OF SITE BEING OCCUPIED BY OTHERS OR TO BE HANDOVER TO THE CONTRACTOR IF INSTRUCTED BY THE EMPLOYER
- SITE OF THE EXISTING TEMPORARY CONSTRUCTION SITE FOR ACCESSIBILITY BY THE CONTRACTOR

**REVISION:**

NO.	DATE	DESCRIPTION	BY	CHK'D
01	2016.04.18	INITIAL ISSUE	K. Y. TAM	L. NG
02	2016.04.18	ISSUED	L. NG	

DESIGNED BY: K. Y. TAM  
 CHECKED BY: L. NG  
 DATE: 26.4.2016  
 CONTRACT NO.: CV203/97  
 TITLE NO.:  
 PROJECT NO.:  
 CONTRACT:  
**HANDLING OF SURPLUS PUBLIC FILL (2016-2018)**  
 DRAWING TITLE:  
**PORTION A - FILLING KWAN O AREA 137 FILL BANK**  
 SCALE: 1:200  
 SHEET NO.: FM10077-2-A  
 TOTAL SHEETS: 45  
 OFFICE: CIVIL ENGINEERING DIVISION  
 CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT  
 HONG KONG GOVERNMENT

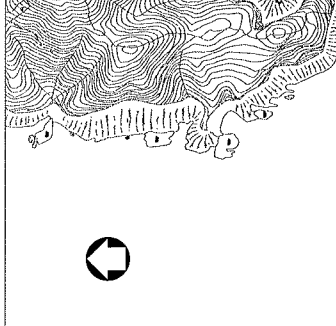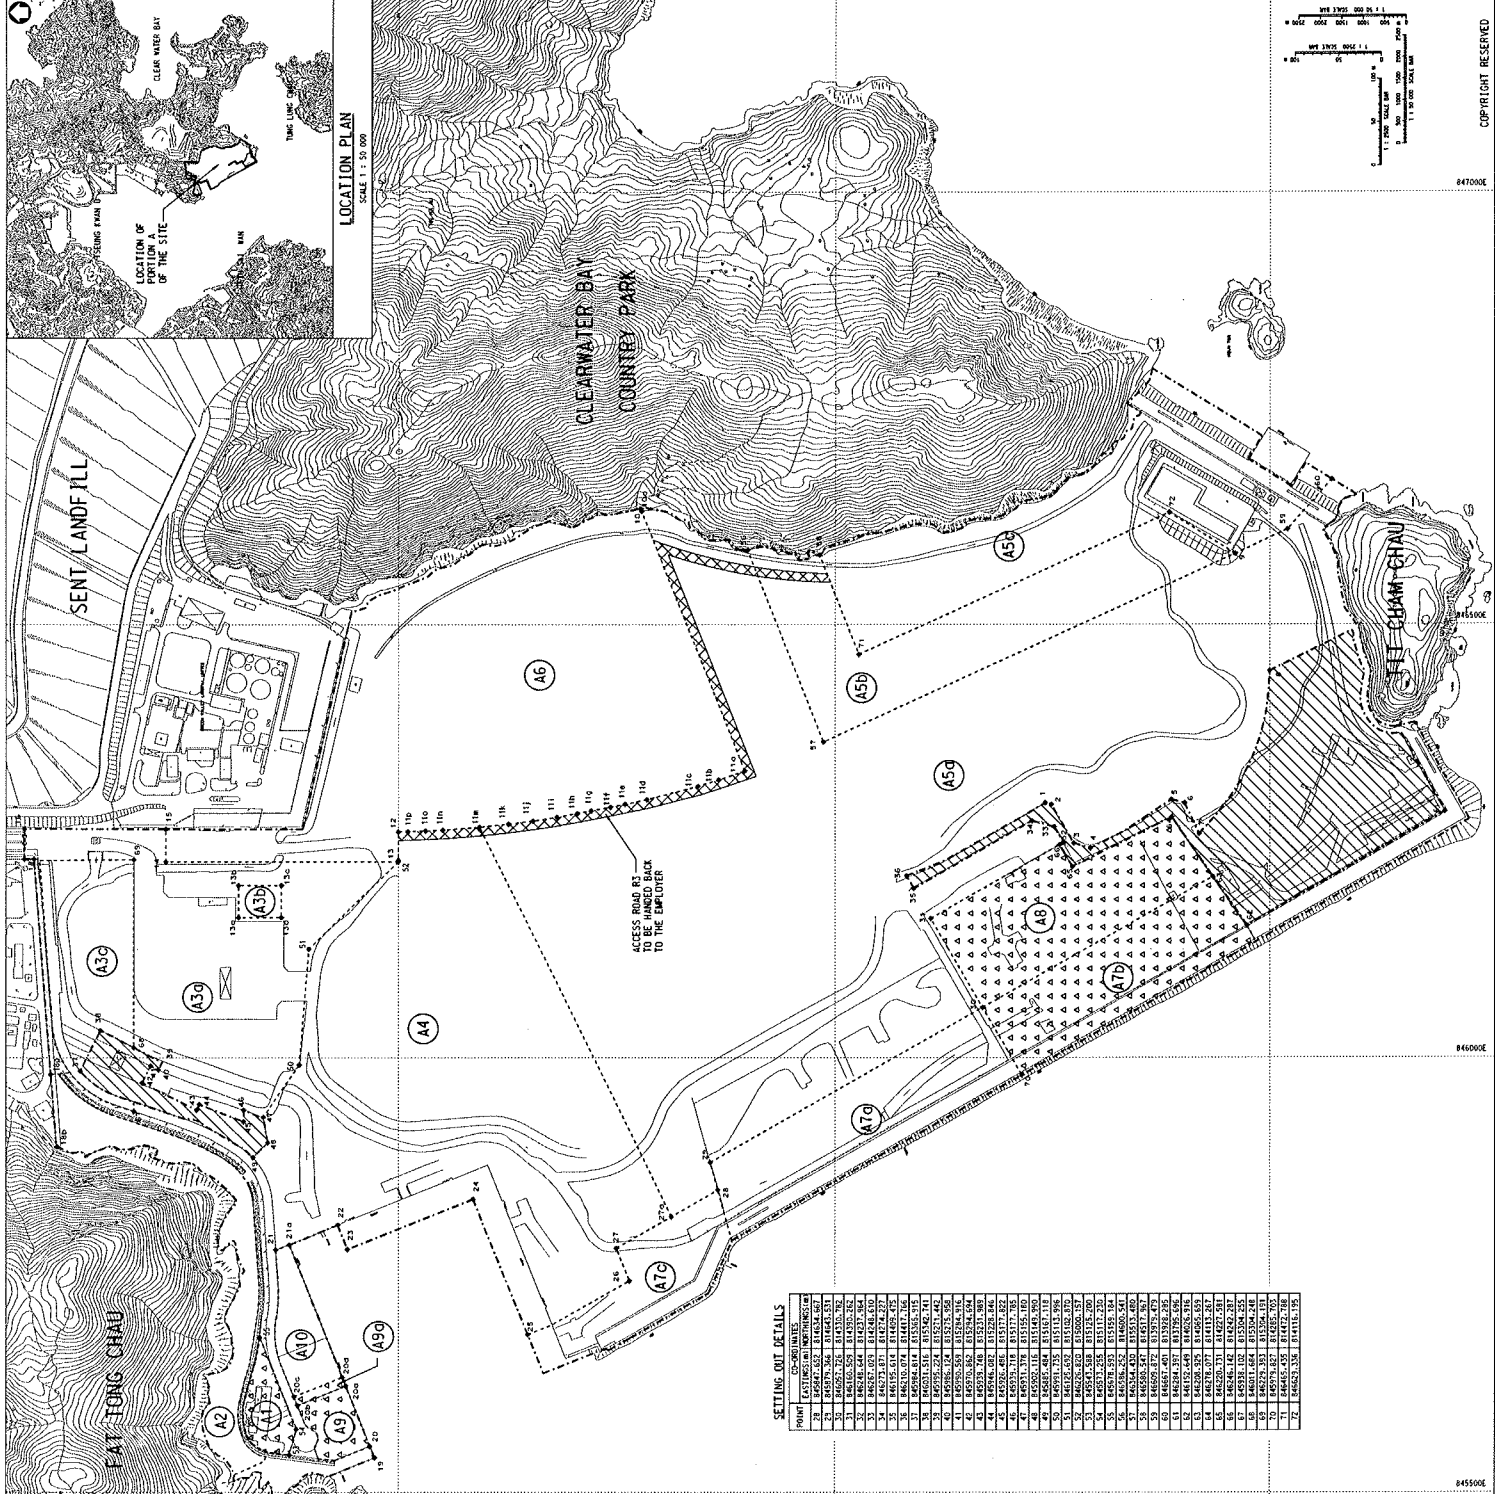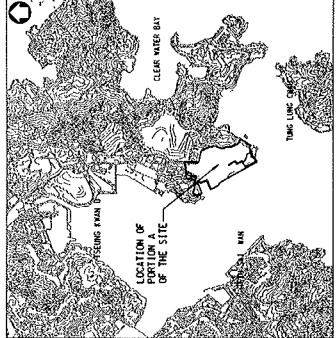


**SETTING OUT DETAILS**

POINT NO.	EASTING (M)	NORTHING (M)
1	718143.407	718026.488
2	718143.407	718026.488
3	718143.407	718026.488
4	718143.407	718026.488
5	718143.407	718026.488
6	718143.407	718026.488
7	718143.407	718026.488
8	718143.407	718026.488
9	718143.407	718026.488
10	718143.407	718026.488
11	718143.407	718026.488
12	718143.407	718026.488
13	718143.407	718026.488
14	718143.407	718026.488
15	718143.407	718026.488
16	718143.407	718026.488
17	718143.407	718026.488
18	718143.407	718026.488
19	718143.407	718026.488
20	718143.407	718026.488
21	718143.407	718026.488
22	718143.407	718026.488
23	718143.407	718026.488
24	718143.407	718026.488
25	718143.407	718026.488
26	718143.407	718026.488
27	718143.407	718026.488
28	718143.407	718026.488
29	718143.407	718026.488
30	718143.407	718026.488
31	718143.407	718026.488
32	718143.407	718026.488
33	718143.407	718026.488
34	718143.407	718026.488
35	718143.407	718026.488
36	718143.407	718026.488
37	718143.407	718026.488
38	718143.407	718026.488
39	718143.407	718026.488
40	718143.407	718026.488
41	718143.407	718026.488
42	718143.407	718026.488
43	718143.407	718026.488
44	718143.407	718026.488
45	718143.407	718026.488
46	718143.407	718026.488
47	718143.407	718026.488
48	718143.407	718026.488
49	718143.407	718026.488
50	718143.407	718026.488
51	718143.407	718026.488
52	718143.407	718026.488
53	718143.407	718026.488
54	718143.407	718026.488
55	718143.407	718026.488
56	718143.407	718026.488
57	718143.407	718026.488
58	718143.407	718026.488
59	718143.407	718026.488
60	718143.407	718026.488
61	718143.407	718026.488
62	718143.407	718026.488
63	718143.407	718026.488
64	718143.407	718026.488
65	718143.407	718026.488
66	718143.407	718026.488
67	718143.407	718026.488
68	718143.407	718026.488
69	718143.407	718026.488
70	718143.407	718026.488
71	718143.407	718026.488
72	718143.407	718026.488

**SETTING OUT DETAILS**

POINT NO.	EASTING (M)	NORTHING (M)
73	718143.407	718026.488
74	718143.407	718026.488
75	718143.407	718026.488
76	718143.407	718026.488
77	718143.407	718026.488
78	718143.407	718026.488
79	718143.407	718026.488
80	718143.407	718026.488
81	718143.407	718026.488
82	718143.407	718026.488
83	718143.407	718026.488
84	718143.407	718026.488
85	718143.407	718026.488
86	718143.407	718026.488
87	718143.407	718026.488
88	718143.407	718026.488
89	718143.407	718026.488
90	718143.407	718026.488
91	718143.407	718026.488
92	718143.407	718026.488
93	718143.407	718026.488
94	718143.407	718026.488
95	718143.407	718026.488
96	718143.407	718026.488
97	718143.407	718026.488
98	718143.407	718026.488
99	718143.407	718026.488
100	718143.407	718026.488

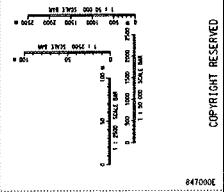

847000  
 846000  
 845500  
 845000  
 81 1000 x 107  
 COPYRIGHT RESERVED

## **Appendix**

### **K**

#### **Weather Condition**

## Daily Extract of Meteorological Observations, May 2017 – Tseung Kwan O

Day	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)					
01	***	28.2	23.5	19.9	21.0	86	0.0	190	4.4
02	***	29.4	25.7	22.7	23.2	87	0.0	190	4.0
03	***	30.1	26.8	24.7	24.2	86	0.0	190	4.9
04	***	26.3#	24.2	22.2#	23.4	95	46.5	200	3.9
05	***	30.1#	25.2	21.6#	22.7	87	0.0	180	3.5
06	***	32.0	27.0	23.3	23.4	82	0.0	030	5.4
07	***	25.9	25.1	24.3	22.5	85	0.0	060	6.0
08	***	26.5	25.1	22.1	22.7	87	13.0	040	5.3
09	***	30.0#	25.0	21.8#	22.8	88	7.0	190	3.6
10	***	30.6	26.6	23.6	23.7	85	0.0	010	4.0
11	***	30.3	26.8	25.0	23.7	84	0.0	100	5.3
12	***	32.7	27.4	24.7	22.9	78	0.0	230	4.4
13	***	27.8	24.9	23.2	22.9	89	5.0	240	2.2
14	***	29.8#	25.8	22.9#	23.9	90	0.5	190	3.5
15	***	26.4	24.7	24.0	24.0	96	20.0	040	3.7
16	***	26.1#	23.9	22.5#	22.3	91	9.5	060	5.5
17	***	29.4	24.9	21.7	21.3	81	0.0	030	4.5
18	***	27.3	24.9	23.5	20.2	76	0.0	020	7.5
19	***	25.9	24.1	23.1	20.7	82	0.5	020	9.1
20	***	23.9	22.9	21.7	21.8	94	2.0	010	7.2
21	***	24.1	23.1	22.1	22.3	95	14.5	020	6.6
22	***	24.4	23.9	22.9	23.4	97	18.0	010	4.7
23	***	27.7	25.4	24.3	24.6	95	24.5	010	3.9
24	***	25.7	24.6	22.8	24.3	98	210.0	330	3.6
25	***	29.3	24.7	22.2	21.6	84	0.0	010	5.7
26	***	26.4	23.6	21.8	20.7	84	0.0	020	3.8
27	***	30.0	25.0	21.2	18.2	69	0.0	060	5.8
28	***	30.3	26.2	23.4	19.3	67	0.0	060	6.8
29	***	30.1	26.0	24.0	20.9	74	0.0	020	7.7
30	***	29.4	25.9	24.0	22.8	83	0.0	010	5.5
31	***	33.4	28.2	24.1	23.9	79	0.0	190	5.1

\*\*\* unavailable

# data incomplete

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected



## Daily Extract of Meteorological Observations, June 2017 – Tseung Kwan O

Day	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)					
01	***	31.1	29.0	27.4	25.4	81	0.0	190	8.8
02	***	31.0	29.5	28.6	26.0	82	0.0	190	8.9
03	***	34.3	30.5	28.7	26.2	78	0.0	190	9.0
04	***	31.4	29.6	28.4	26.7	85	1.5	190	5.9
05	***	32.5	29.5	28.3	26.6	85	0.0	190	5.0
06	***	32.1	29.2	27.6	26.4	85	2.5	190	5.4
07	***	32.7	28.8	25.9	26.1	86	11.0	190	5.4
08	***	33.0	29.3	26.5	25.7	82	0.0	100	6.1
09	***	32.5	29.5	27.5	25.2	78	0.0	120	7.3
10	***	32.6	29.5	26.9	25.7	80	0.0	190	5.1
11	***	33.2	29.6	26.6	25.5	80	0.0	190	4.9
12	***	31.1	27.4	25.1	25.3	89	51.0	030	11.5
13	***	27.2	25.7	23.9	25.2	97	216.0	190	4.3
14	***	29.3	27.6	25.3	25.9	91	16.5	220	4.3
15	***	31.7	28.2	26.4	26.1	89	18.0	190	5.3
16	***	29.0	28.0	26.8	26.2	90	17.5	200	6.5
17	***	28.5	25.3	24.3	25.0	98	147.0	070	2.4
18	***	27.3	25.5	24.3	24.8	96	27.5	190	2.6
19	***	28.3	25.8	24.4	25.1	96	32.5	290	2.8
20	***	27.6	25.9	24.4	25.0	95	21.0	200	3.0
21	***	28.3#	26.6	25.0#	25.6	94	111.0	190	3.5
22	***	33.0	29.2	27.2	25.8	83	0.0	180	4.5
23	***	31.9	28.7	26.5	25.8	85	0.0	190	4.3
24	***	32.6	28.6	26.7	25.9	86	6.5	180	4.6
25	***	32.6	29.2	26.4	25.2	80	4.0	190	6.0
26	***	33.2	29.4	27.4	25.6	80	3.0	190	6.7
27	***	32.9	29.3	26.9	25.6	81	0.5	230	6.3
28	***	34.0	29.8	26.9	24.7	75	0.0	230	6.0
29	***	34.4	29.5	26.2	24.9	77	0.0	180	5.4
30	***	32.9	28.7	25.3	24.5	79	0.0	190	3.7

\*\*\* unavailable

# data incomplete

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected

## Daily Extract of Meteorological Observations, July 2017 – Tseung Kwan O


Day	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)					
01	***	32.4	28.6	25.4	25.1	82	11.5	180	4.5
02	***	30.8#	27.9	25.5#	25.9	89	3.5	190	3.8
03	***	30.9	27.9	25.8	25.7	88	2.5	190	4.8
04	***	29.5	26.0	24.6	25.1	95	47.0	060	3.9
05	***	30.2	27.4	25.1	25.7	91	13.5	070	6.0
06	***	29.7	27.1	25.7	25.6	92	30.0	110	6.5
07	***	31.1	27.0	25.2	25.0	89	10.0	100	5.5
08	***	28.6	27.0	25.5	26.0	94	20.0	200	3.3
09	***	31.7	28.7	26.5	25.7	84	1.5	190	5.3
10	***	32.6	28.8	25.8	25.1	81	0.0	190	5.4
11	***	32.2	28.8	26.0	25.2	82	0.0	190	4.4
12	***	32.1	28.7	26.4	25.5	84	0.0	110	4.5
13	***	32.8	29.4	26.5	26.0	83	0.0	120	6.0
14	***	31.9	28.7	26.2	25.9	85	12.0	130	6.2
15	***	31.8	28.7	26.3	25.6	83	1.5	120	7.0
16	***	28.9	27.5	25.9	25.6	90	21.0	120	7.0
17	***	28.7	26.0	24.2	25.1	95	213.5	070	6.0
18	***	28.7	25.9	24.5	25.0	95	183.0	110	6.0
19	***	30.5	26.9	24.1	25.5	92	26.0	010	4.3
20	***	30.0	28.1	26.4	26.1	89	3.5	060	6.3
21	***	32.1	29.0	26.8	25.9	84	0.0	060	7.1
22	***	32.5	28.8	25.7	25.5	83	0.5	070	6.2
23	***	27.7	26.5	25.4	25.0	92	17.0	340	6.2
24	***	30.3	27.3	25.1	25.9	92	15.5	020	5.1
25	***	31.7	28.7	26.7	26.2	87	0.5	050	4.6
26	***	34.1	28.7	25.5	25.2	83	0.0	030	4.5
27	***	30.9	28.4	26.6	25.5	85	0.0	040	6.3
28	***	34.2	29.8	27.2	24.8	76	0.0	010	7.3
29	***	35.6	30.5	26.7	26.0	78	0.0	190	4.5
30	***	36.4	31.7	27.6	26.8	76	0.0	190	5.5
31	***	33.4	30.8	28.9	26.6	78	0.0	190	7.2

\*\*\* unavailable

# data incomplete

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected


## Figures

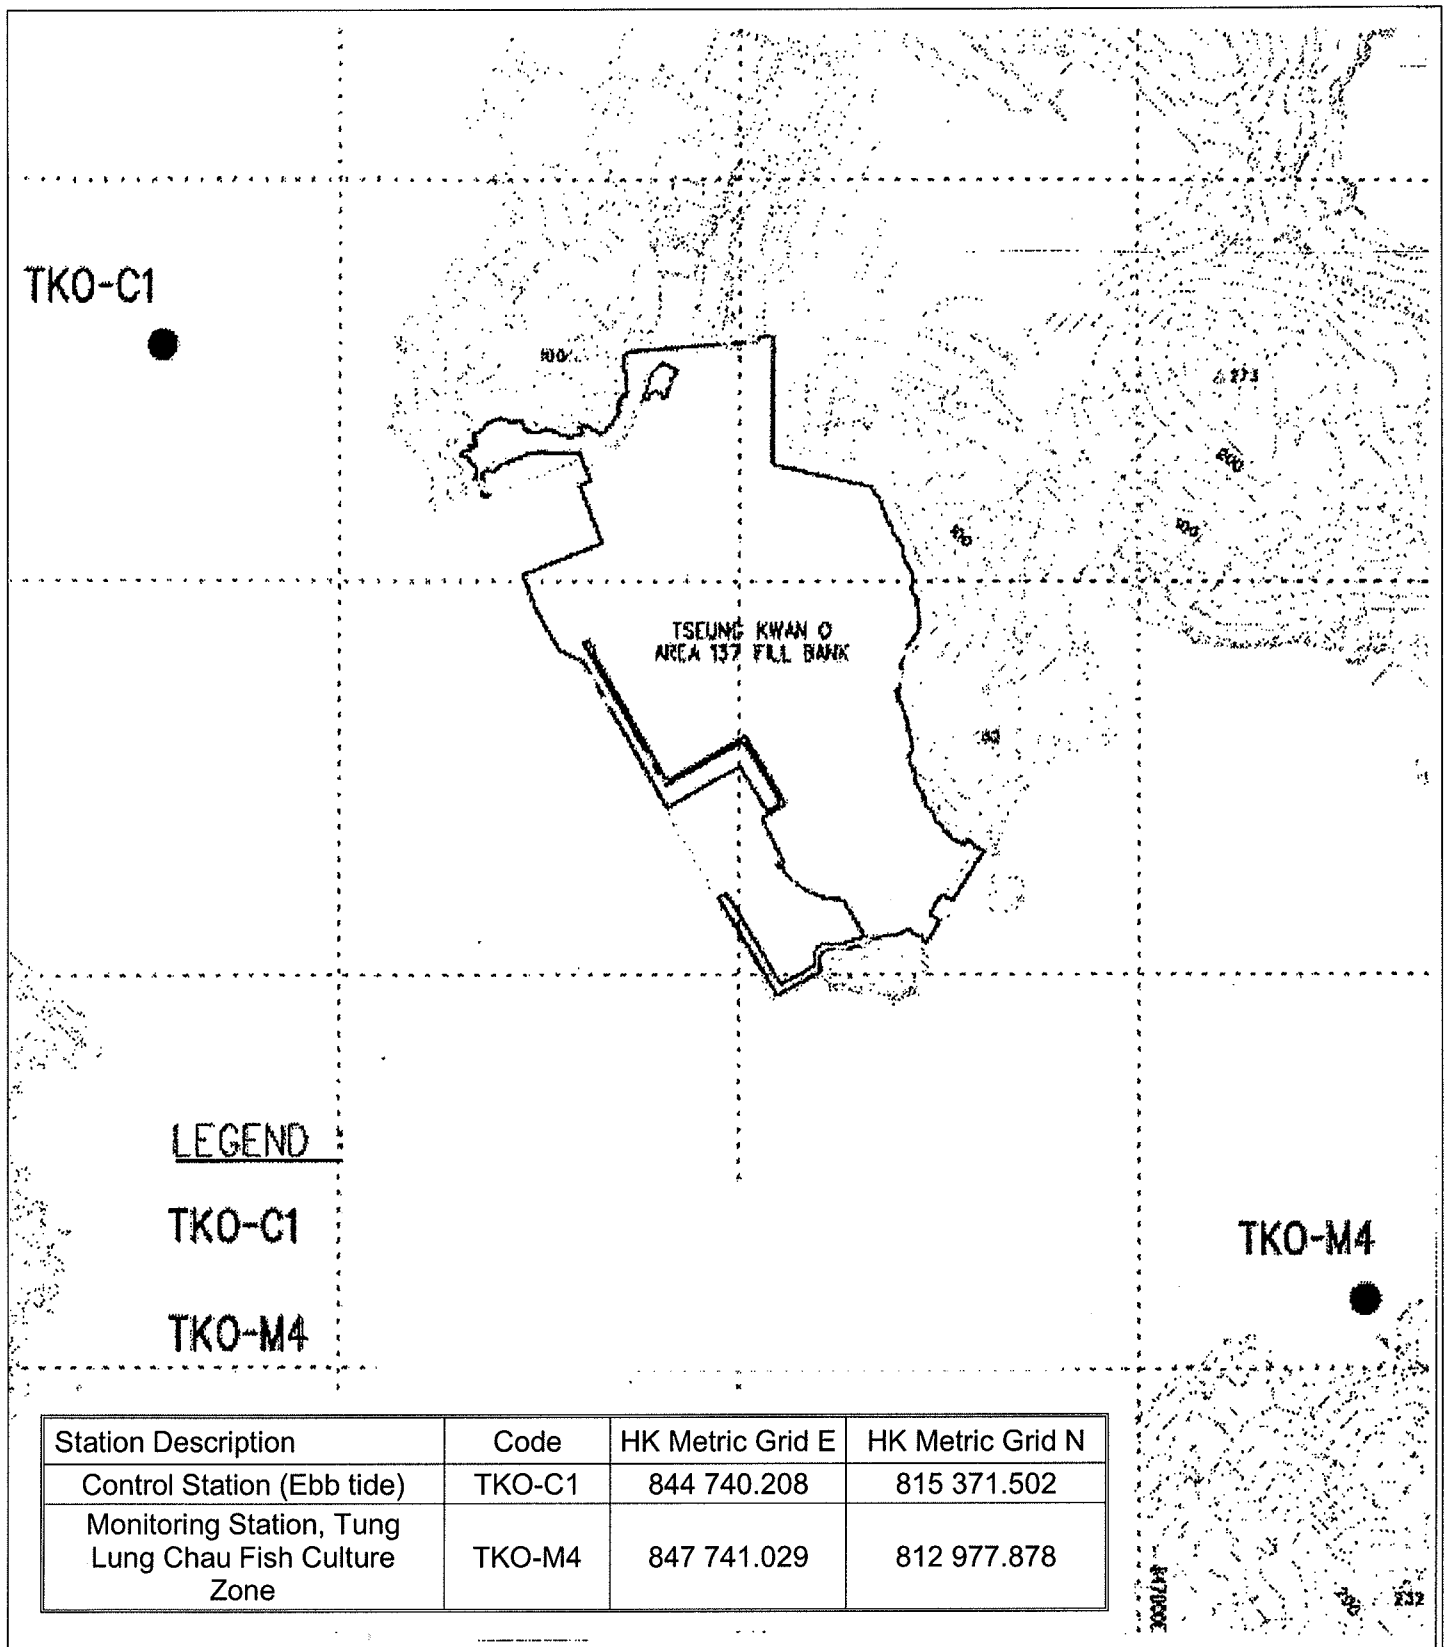

Contract No. CV/2015/07  
 Handling of Surplus Public Fill (2016-2018)


Figure 1  
 Locations of Water Quality Monitoring Stations –  
 Tseung Kwan O Area 137 Fill Bank



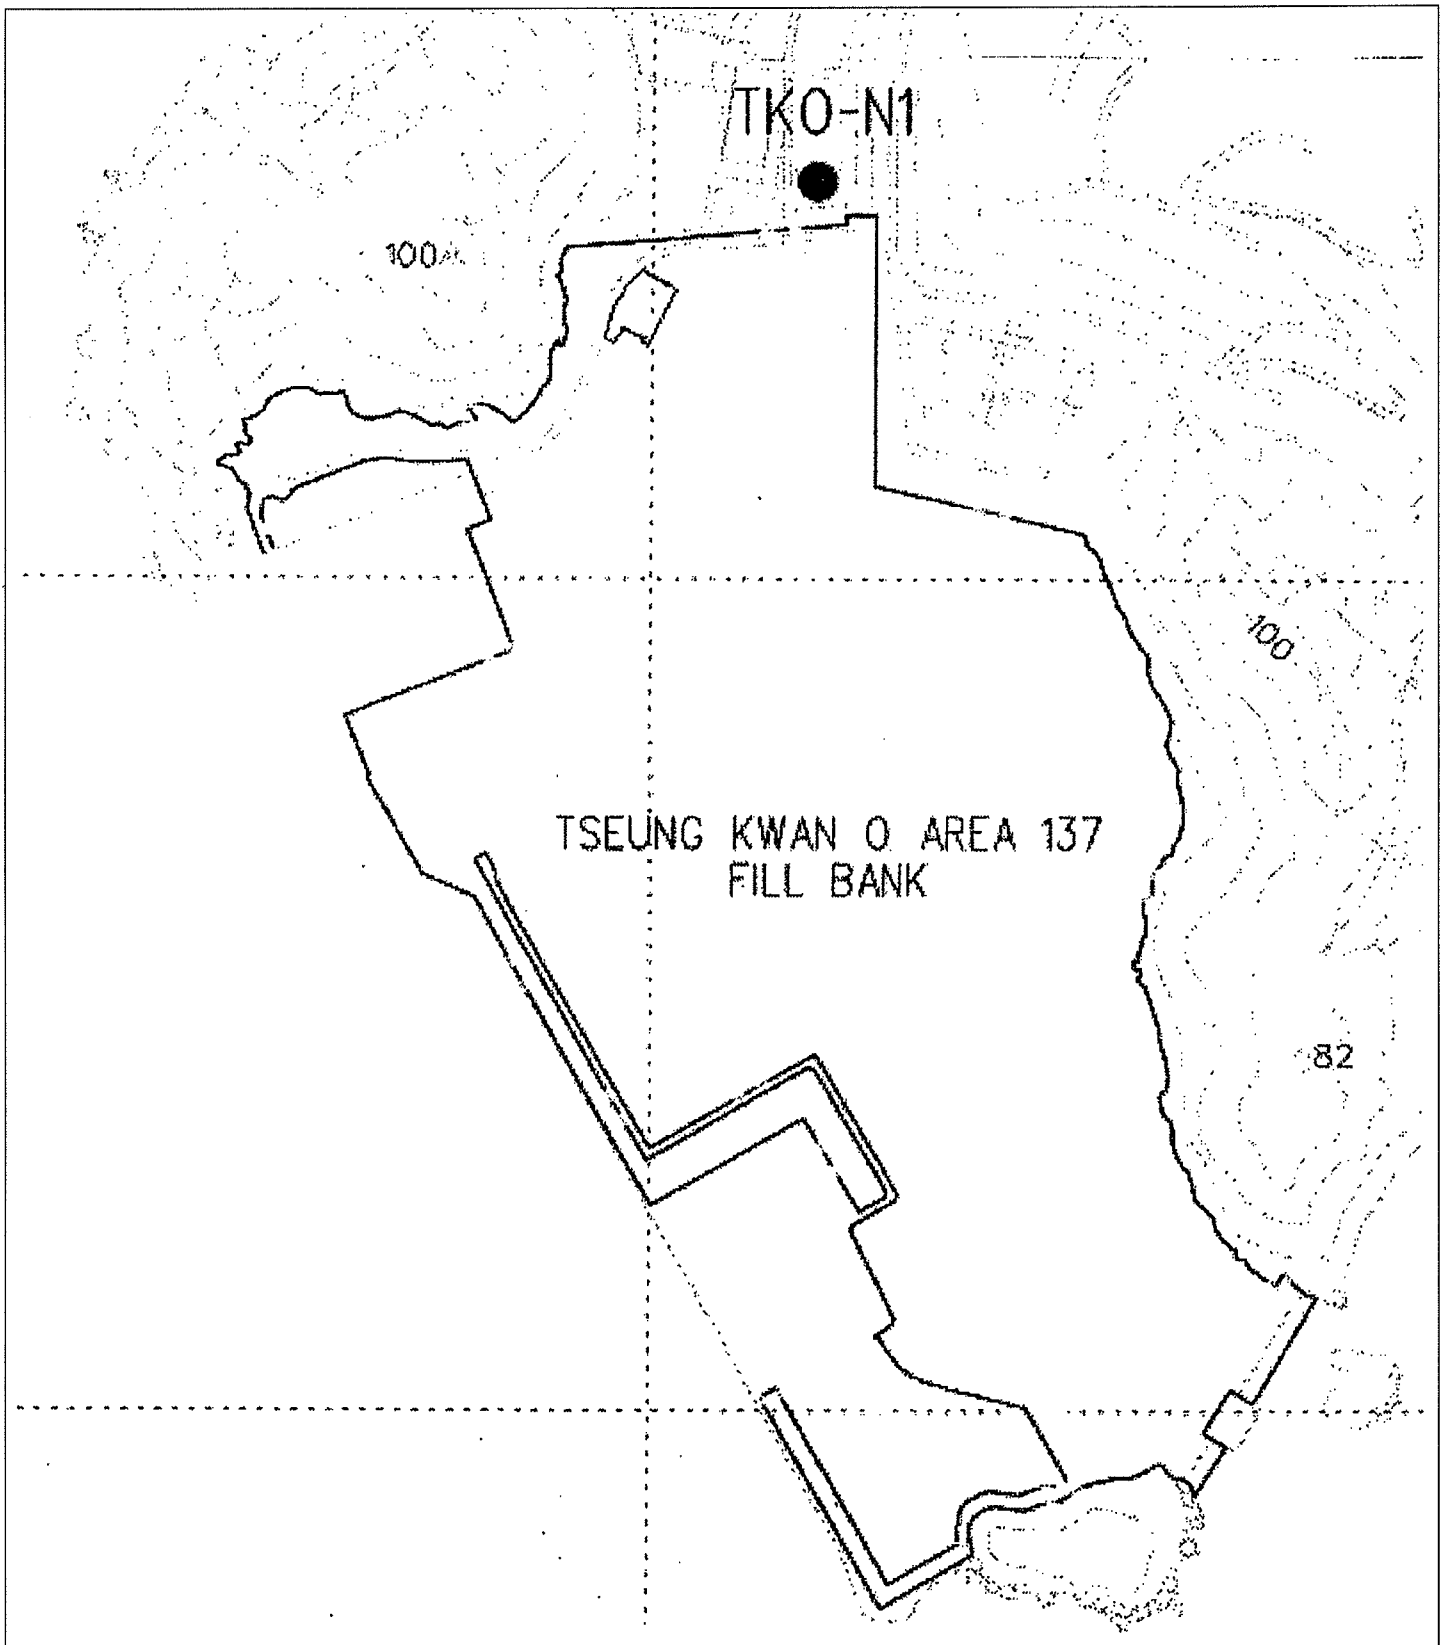

Contract No. CV/2015/07  
Handling of Surplus Public Fill (2016-2018)

Figure 2  
Location of Noise Monitoring Station –  
Tseung Kwan O Area 137 Fill Bank

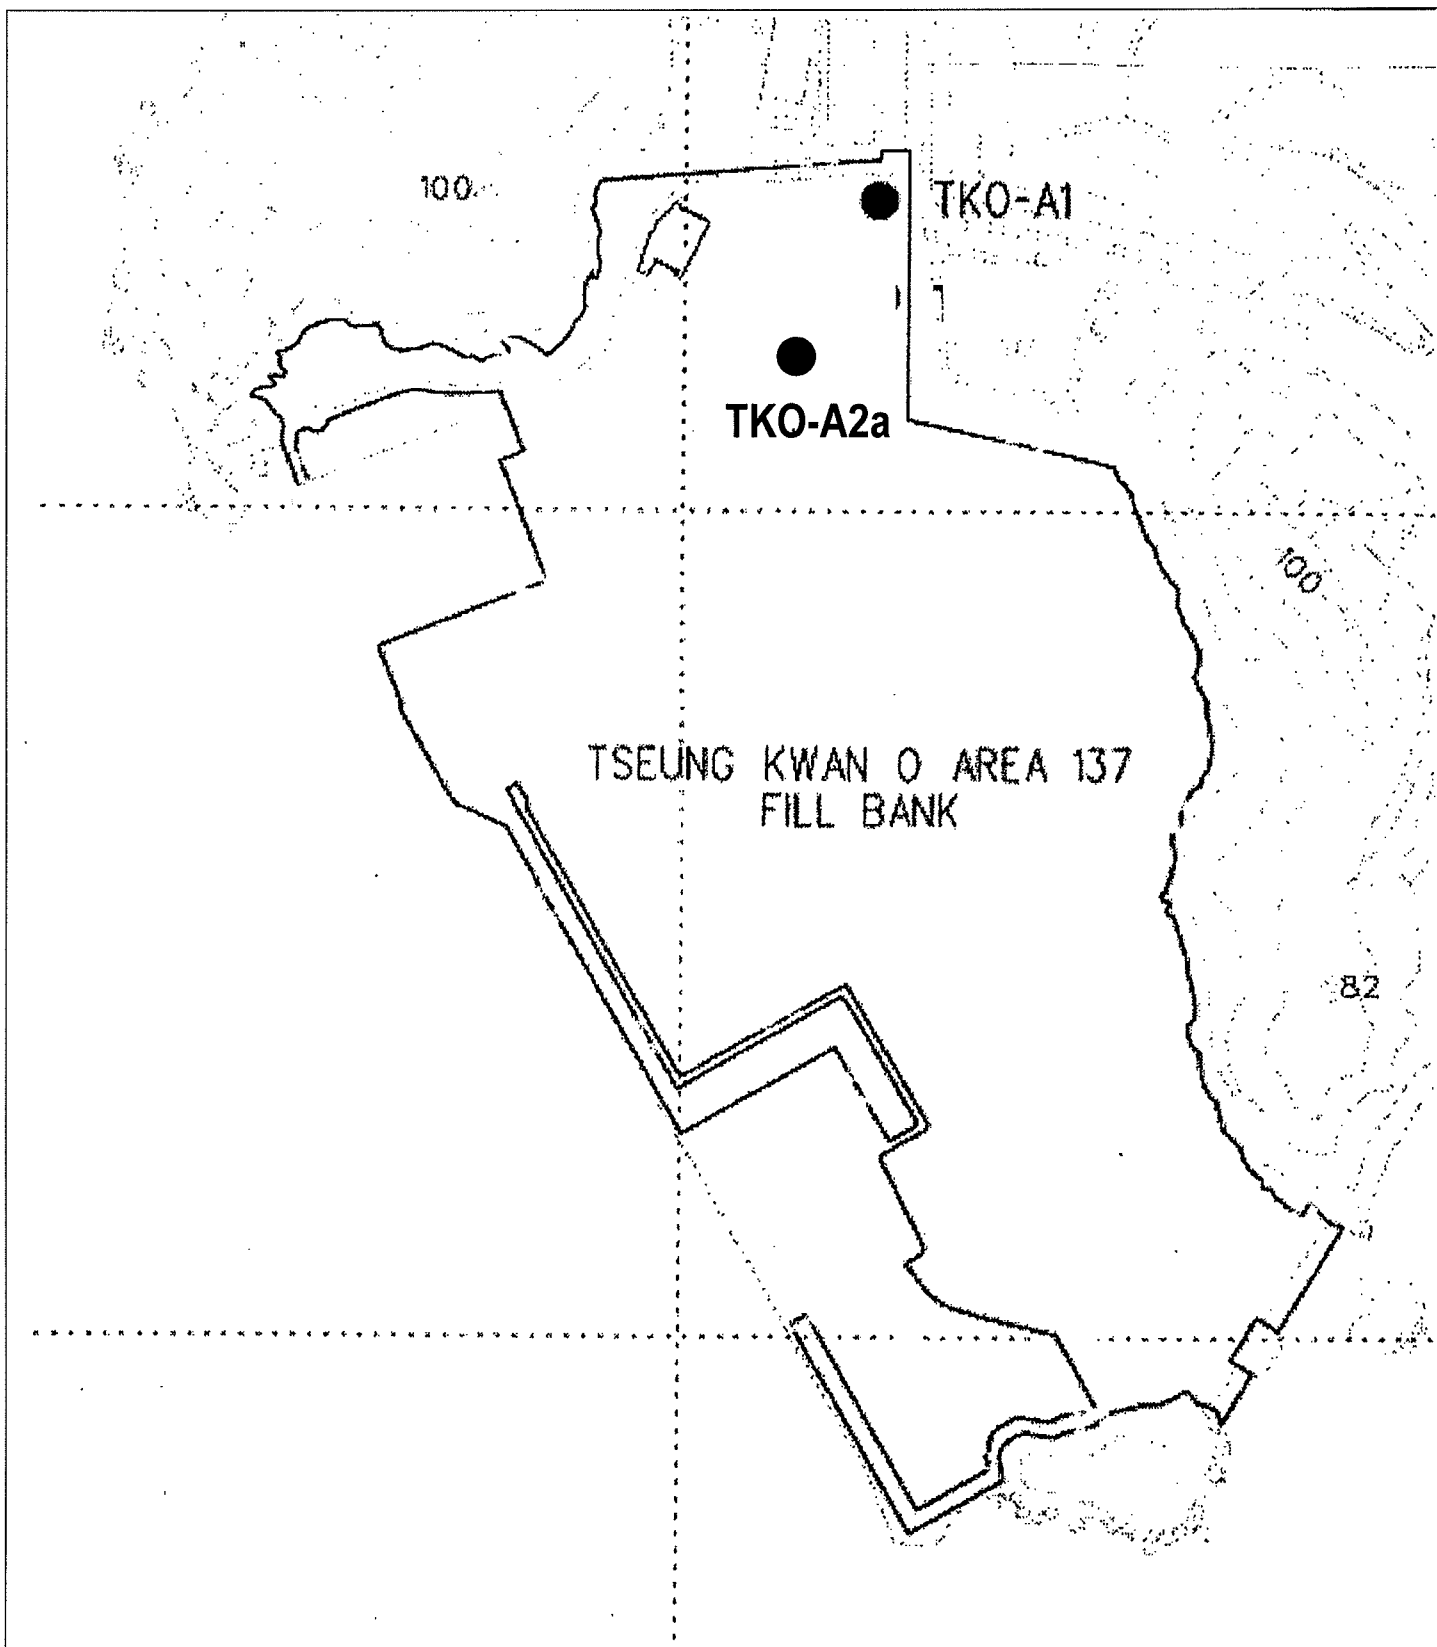

Contract No. CV/2015/07  
 Handling of Surplus Public Fill (2016-2018)

Figure 3  
 Locations of Air Quality Monitoring Stations –  
 Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司  
 ETS-TESTCONSULT LIMITED