

Airport Management Services Limited

SkyCity Nine Eagles Golf Course EM&A

Quarterly Compliance Report



August to
October 2007

Report no: 01508R0021



Airport Management Services Limited

SkyCity Nine Eagles Golf Course EM&A Quarterly Compliance Report

August to October 2007

Author: Winnie MA

Checker: Alexi BHANJA

Approver: Guiyi LI

Report no: 01508R0021

Date: 31 October 2007

Winnie
Alexi Bhanja
Guiyi Li

This report has been prepared for Airport Management Services Limited in accordance with the terms and conditions of appointment for Quarterly Compliance Report dated 10 March 2006. Hyder Consulting Ltd (COI Number 126012) cannot accept any responsibility for any use of or reliance on the contents of this report by any third party.

Hyder Consulting Ltd

COI Number 126012

47th Floor, Hopewell Centre, 183 Queens Road East, Wanchai, Hong Kong

Tel: +852 2911 2233 Fax: +852 2805 5028 www.hyderconsulting.com





Contents

1	Executive Summary	1
2	Lake Water Quality EM&A.....	3
2.1	Overview.....	3
2.2	EM&A Programme.....	3
2.2.1	Equipment and Methodology.....	4
2.2.2	Maintenance and Calibration.....	4
2.2.3	Parameters Monitored.....	4
2.2.4	Monitoring Locations.....	5
2.2.5	Monitoring Date, Time, Frequency and Duration.....	5
2.3	Action/Limit Levels.....	5
2.4	Summary of Exceedances.....	6
2.4.1	Review of Exceedances and Implications.....	6
2.4.2	Action Taken and Follow-up.....	7
2.5	Operational Results.....	7
2.6	Complaints and Notifications of Summons.....	8
2.6.1	Complaints.....	8
2.6.2	Notifications of Summons.....	8
2.7	Future Monitoring Schedule.....	8
3	Comments, Recommendations and Conclusions.....	11



Figures

- Figure 1-1 Location of SkyCity Golf Course on the Airport Island
- Figure 2-1 Schematic of Lake Water Control System
- Figure 2-2 Locations for Lake Water Quality Monitoring

Tables

- Table 2-1 In-situ Monitoring Equipment Details
- Table 2-2 Monitoring Frequency
- Table 2-3 Action and Limit Levels for Lake Water Quality
- Table 2-4 Event Action Plan for Lake Water Quality Monitoring
- Table 2-5 Summary of Compliance Monitoring Data During Reporting Quarter
- Table 2-6 Operational Results
- Table 2-7 Future Monitoring Schedule

Appendices

- Appendix 1 Lake Water Quality Monitoring Data
- Appendix 2 Graphical Plots of the Monitoring Results
- Appendix 3 Equipment Calibration Details

1 Executive Summary

The purpose of this Project is to construct and operate a 9-hole Golf Course at the east side of the North Commercial District (NCD) on the Airport Island as an interim arrangement prior to the area's future development as a business park (see **Figure 1-1**). The proposed interim golf facility, known as "SkyCity Nine Eagles Golf Course" is intended to serve airport passengers, overseas visitors and airport workers until August 2013.

The Project is managed by Airport Management Services Limited (AMS) who have engaged Green Management Ltd to establish and maintain the turfgrass of the Golf Course. Hyder Consulting have been employed as the Environmental Team (ET) for the Operation Period and have engaged ALS Technichem Pty Ltd as the HOKLAS accredited testing laboratory to carry out lake water analysis.

The Construction Period was completed on 31 December 2006. The first phase of the Operation was completed on 30 April 2007 and the second phase of the Operation Period commenced on 1 May 2007.

According to the approved EM&A Manual compliance monitoring of lake water quality during the second phase of the Operation Period is required on a monthly basis. Parameters tested for include suspended solids, dissolved oxygen, BOD₅, nitrogen, phosphorous, temperature and salinity. Monthly compliance monitoring was carried out on 10 August, 14 September and 12 October 2007 at four locations within the two lakes.

According to the approved EM&A Manual reporting during the second phase of the Operation Period is required on a quarterly basis. This is the second Quarterly Compliance report covering August 2007 to October 2007 and complies with the reporting requirements stated in the approved EM&A Manual. A lake water monitoring schedule for the next quarter is provided in Section 2.7.

During the reporting quarter, exceedances of the Action Level for Suspended Solids (SS) were recorded at W3 and W4 on 12 October 2007. According to the Event Action Plan, EPD and the Golf Course Supervisor were notified as soon as the results were available and weekly monitoring of SS has been implemented until SS levels drop below the Action Level. Furthermore, the Golf Course Supervisor was immediately advised that lake water was not of an acceptable quality and that the control valve (to allow discharge of lake water) must not be opened until SS levels drop below the Action Level. The exceedances have been attributed to maintenance works of the fountain in Lake B at the time of sampling – workers were in the water and causing sediment to become suspended. As such, it is expected that the next SS monitoring results from W3 and W4 will return to normal, i.e., below the Action Level. Although exceedances have been recorded, there has been no discharge of lake water off-site during the reporting quarter and so there have been no external environmental impacts resulting from the high SS levels.

During the reporting quarter, there were no exceedance of Limit Levels for lake water quality; no complaints received; and there were no notifications of summons. Overall, there have been no adverse off-site environmental impacts during the reporting quarter.

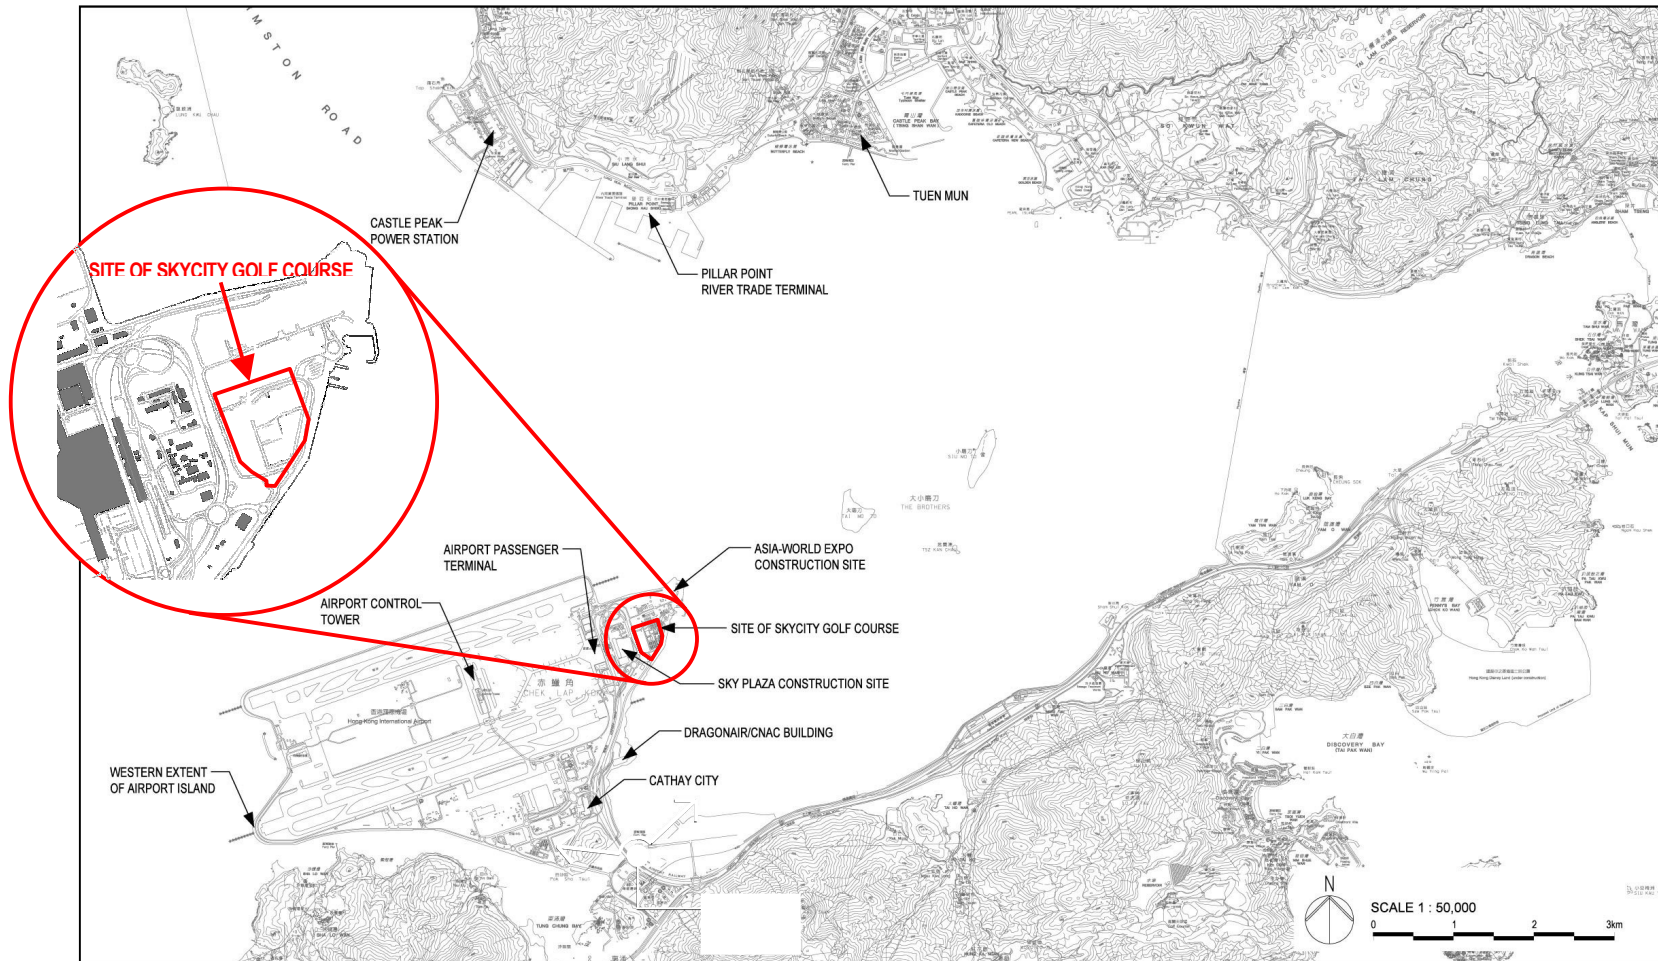


Figure 1-1 Location of SkyCity Golf Course on the Airport Island

2 Lake Water Quality EM&A

2.1 Overview

The Golf Course has been designed to contain water within two artificial lakes, which are linked together by two underwater pipes,. Because of the sloping topography of the site, all rainwater collected within the Golf Course will drain into the lakes through a sub-soil drainage system. The lakes provide a source of freshwater for irrigation, from which surplus water will flow back into the lakes.

The lakes are normally maintained at a capacity of 15,000m³. This is not "full" but is the level that provides the required visual appearance. During the winter (dry) months, however, the lake water may fall below this level. The maximum capacity of the lakes is 20,000m³.

If more than 20,000m³ of water flows into the lakes, then the Golf Course may flood. To avoid this, the Golf Course Supervisor can authorise the opening of a control valve to allow the water to overflow from the lake and into off-site storm drains that discharge via Outfall No. 8. However, the valve can only be opened if the latest lake water monitoring results indicate that water is of an acceptable quality. In normal circumstances, the control valve remains closed and discharge off-site is not possible. All opening/closing of the control valve is logged on site.

If the latest lake water monitoring results indicate that water is not of an acceptable quality, then the valve cannot be opened, the lake water cannot overflow and the Golf Course may begin to flood. This is part of the mitigation design to prevent off-site discharge of water that does not meet the required standard.

The bund that surrounds the site is at least 1.5m high and up to 90,000m³ of floodwater can be retained within the Golf Course in addition to the 20,000m³ lake capacity. In this situation, water samples from the flooded Golf Course will be taken more frequently. Only when water has returned to an acceptable quality will the control valve be opened to allow water to overflow from the lake and into off-site storm drains that discharge via Outfall No. 8, thereby allowing the flood to recede.

The system by which this water control is achieved is shown in **Figure 1-1**.

2.2 EM&A Programme

Monitoring of Dissolved Oxygen (DO) concentration in mg/l, Suspended Solids (SS) in mg/l, BOD₅ in mg/l, Total Nitrogen in mg/l, Total Phosphorous in mg/l and Salinity in mg/l, was carried out by the ET to ensure that any deterioration in lake water quality could be readily detected and timely action could be taken to rectify the situation if this was due to site operations. DO was measured *in-situ* whilst SS was determined in a HOKLAS-accredited laboratory.

2.2.1 Equipment and Methodology

Because of the relatively shallow water, *in-situ* measurements and water sampling were conducted at 0.5m from the surface (the mid-point of the 1m deep lake). Water samples for all monitoring parameters were collected, stored, preserved and analysed according to *APHA Standard Methods for the Examination of Water and Wastewater, 19th Edition, #17*.

In-situ DO concentration and DO saturation were carried out using a YSI Model 85 CE-C-M-Y multi-parameter meter and the range, resolution and accuracy of the equipment is provided in **Table 2-1**:

Parameter	YSI Model 85 CE-C-M-Y		
	Range	Resolution	Accuracy
DO Concentration	0 to 12 mg/l	0.001 mg/l	0 to 20 mg/l: ± 0.2 mg/l of reading
DO Saturation	0 to 150%	0.1%	0 to 100%: $\pm 1\%$ of reading

Table 2-1 *In-situ* Monitoring Equipment Details

A Kahlisco water sampler was used to obtain the water sample for subsequent SS analysis. The volume of the sample shall not be less than 1l and shall be collected in clean high density polythene bottles, packed in ice (cooled to 4 °C without being frozen), and delivered to ALS' laboratory (HOKLAS accredited) immediately after completion of monitoring. The determination of the collected samples will start within the next working day after sample collection. The analysis follows *APHA Standard Methods #2540D*.

2.2.2 Maintenance and Calibration

All *in-situ* monitoring instruments are calibrated and certified by ALS at monthly intervals throughout all stages of the lake water quality monitoring programme.

For DO, the probe (YSI 85) is calibrated once per monitoring day by the wet bulb method. Calibration at ALS is carried out once every month in a water sample of known dissolved oxygen concentration. The sensor is immersed in the water and after thermal equilibration, the known mg/l value is keyed in and the calibration is carried out automatically. Calibration details are provided in **Appendix 3**.

2.2.3 Parameters Monitored

The following parameters are monitored and compared to A/L Levels:

- Dissolved Oxygen (DO)
- Suspended Solids (SS)
- BOD₅
- Total Nitrogen
- Total Phosphorous

2.2.4 Monitoring Locations

Monitoring locations together with grid references are shown in **Figure 2-2**. Monitoring Stations are designated as W1, W2, W3 and W4.

2.2.5 Monitoring Date, Time, Frequency and Duration

In accordance with the EM&A Manual, the monitoring frequency of lake water quality is shown as **Table 2-2**:

	Operation Phase	
	Below Action/Limit Level	Action/Limit Level Exceedance
Monitoring Frequency	Monthly	Weekly

Table 2-2 Monitoring Frequency

2.3 Action/Limit Levels

According to the approved EM&A manual, the A/L Levels for the compliance monitoring (for monitoring locations W1 to W4) are shown in **Table 2-3**:

Parameter	Acceptable Standard (mg/l)*	
	Action Level	Limit Level
Suspended Solids	20	30
BOD ₅	13.5	20
Dissolved Oxygen	4	3
Total Nitrogen	20	30
Total Phosphorous	3.5	5

Table 2-3 Action and Limit Levels for Lake Water Quality

In case of exceedance of A/L Levels at monitoring locations W1 to W4, ET shall immediately implement the Event/ Action Contingency Plan as shown in the following **Table 2-4** in order to resolve the lake water quality problem:

Event	Action
Exceedance of Action Level	<ol style="list-style-type: none"> 1. Notify the Golf Course Supervisor of the exceedance, providing full details (time, location, parameter, level, etc.). 2. Increase the frequency of monitoring of the particular parameter(s) to "Action/Limit Level Exceedance" as shown in Table 2-2. 3. If water quality continues to worsen, it may be prudent to review the Turfgrass Management Plan (TMP) in terms of application of nutrients and agree any revisions with the Golf Facility Supervisor. 4. Notify the Golf Facility Supervisor when water quality falls below "Action Level" and reduce monitoring frequency to "Below Action/Limit Level" as shown in Table 2-2.

Event	Action
Exceedance of Limit Level	<ol style="list-style-type: none"> 1. Notify EPD and Golf Course Supervisor of the exceedance, providing full details (time, location, parameter, level, etc.). 2. Suspend any ongoing application of organic nutrients. 3. Determine the likely cause of the exceedance(s). Review the TMP in terms of application of nutrients and agree any revisions with the Golf Facility Supervisor. Continue to irrigate the Golf Course using lake water. 4. Increase the frequency of monitoring of the particular parameter(s) to “Action/Limit Level Exceedance” as shown in Table 2-2. (if not already at this frequency) to demonstrate the effectiveness of remedial measures and to confirm that water quality has returned to acceptable levels. 5. Notify EPD and Golf Course Supervisor when water quality falls below “Action Level” (not “Limit Level”) and reduce monitoring frequency to “Below Action/Limit Level” as shown in Table 2-2.

Table 2-4 Event Action Plan for Lake Water Quality Monitoring

2.4 Summary of Exceedances

2.4.1 Review of Exceedances and Implications

A summary of lake water monitoring results for the reporting month is provided in **Table 2-5**, below. Detailed results are provided in **Appendix 1**.

Monitoring Location		Salinity (mg/ℓ)	Temperature (°C)	SS (mg/ℓ)	BOD ₅ (mg/ℓ)	DO Saturation (%age)	DO Concentration (mg/ℓ)	Total Nitrogen (mg/ℓ)	Total Phosphorous (mg/ℓ)
W1	Mean	0.1	29.8	11.0	4.7	100.9	7.5	3.3	0.3
	Minimum	0.1	28.3	9.0	2.0	77.8	5.7	1.6	0.1
	Maximum	0.1	32.3	13.0	6.0	133.0	9.7	6.5	0.7
W2	Mean	0.1	29.8	9.7	5.0	102.0	7.5	1.8	0.1
	Minimum	0.1	28.3	6.0	2.0	76.5	5.2	1.7	0.1
	Maximum	0.1	32.3	13.0	7.0	133.0	9.6	2.0	0.1
W3	Mean	0.1	29.9	12.7	4.7	114.9	8.7	2.9	0.1
	Minimum	0.1	28.6	5.0	2.0	81.6	6.2	1.9	0.1
	Maximum	0.1	32.3	22.0	8.0	135.0	10.0	3.9	0.1
W4	Mean	0.1	30.0	13.3	2.7	118.1	8.9	3.2	0.1
	Minimum	0.1	28.6	4.0	2.0	80.3	6.0	2.0	0.1
	Maximum	0.1	32.3	24.0	4.0	140.0	10.9	4.7	0.1

Notes: **Bold** indicates Action Level exceedance

Bold indicates Limit Level exceedance

Table 2-5 Summary of Compliance Monitoring Data During Reporting Quarter

Graphical plots of the monitoring result since commencement of second phase of Operation from May 2007 are given in **Appendix 2**.

From the above table, there were exceedances of Action Level of SS at W3 and W4 on 12 October 2007. The action taken and follow-up required as a result of these exceedances are discussed in Section 2.4.2, below. The exceedances have been attributed to maintenance works of the fountain in Lake B at the time of sampling – workers were in the water and causing sediment to become suspended. As such, it is expected that the next SS monitoring results from W3 and W4 will return to normal, i.e., below the Action Level.

Although exceedances have been recorded, there has been no discharge of lake water off-site during the reporting quarter and so there have been no external environmental impacts resulting from the high SS levels.

No exceedance of Limit Level for water quality monitoring was recorded during the reporting quarter.

2.4.2 Action Taken and Follow-up

According to the Event Action Plan, EPD and the Golf Course Supervisor were notified as soon as the results were available and weekly monitoring of SS has been implemented until SS levels drop below the Action Level. Furthermore, the Golf Course Supervisor was immediately advised that lake water was not of an acceptable quality and that the control valve (to allow discharge of lake water) must not be opened until SS levels drop below the Action Level.

Follow-up weekly monitoring has been scheduled to commence on 2 November 2007, which was the earliest possible date to schedule the monitoring after the results became available on 24 October 2007. Weekly monitoring will continue until the SS levels have fallen below the Action Level.

2.5 Operational Results

Table 2-6, below, shows the operational results during the reporting quarter, i.e., the activities relating to the management of water in the lakes:

Month	Month-end Lake Water Depth (m)	Can Control Valve Be Opened?	Has Control Valve Been Opened?	Quantity of Water Discharged (m ³)
August 2007	1.5	Yes	No	0
September 2007	1.5	Yes	No	0
October 2007	1.5	No	No	0

Table 2-6 Operational Results

From Section 2.4, the EM&A results for the reporting quarter have shown that A/L Levels were not exceeded in August and September but were exceeded in October. Therefore, while the control valve could have been opened in August and September, it cannot be opened in October, nor until SS levels drop below the Action Level.

Notwithstanding, the Golf Course Supervisor has confirmed that the control valve was NOT opened during the reporting quarter and that water was NOT discharged from the Golf Course.

2.6 Complaints and Notifications of Summons

2.6.1 Complaints

No complaints were received during the reporting month and there are no outstanding follow-up issues to be addressed.

2.6.2 Notifications of Summons

No notifications of summons were received during the reporting month and there are no outstanding follow-up issues to be addressed.

2.7 Future Monitoring Schedule

The lake water monitoring schedule for the next quarter (November 2007 to January 2008) is given in **Table 2-7**, below.

Sampling Date	Sampling Locations
2 November 2007*	W3 and W4
9 November 2007	W1 to W4
14 December 2007	W1 to W4
11 January 2008	W1 to W4

Note: * Additional monitoring of SS only as a result of exceedance in SS level on 12 October 2007. Weekly monitoring will continue until SS levels fall below Action Level

Table 2-7 Future Monitoring Schedule

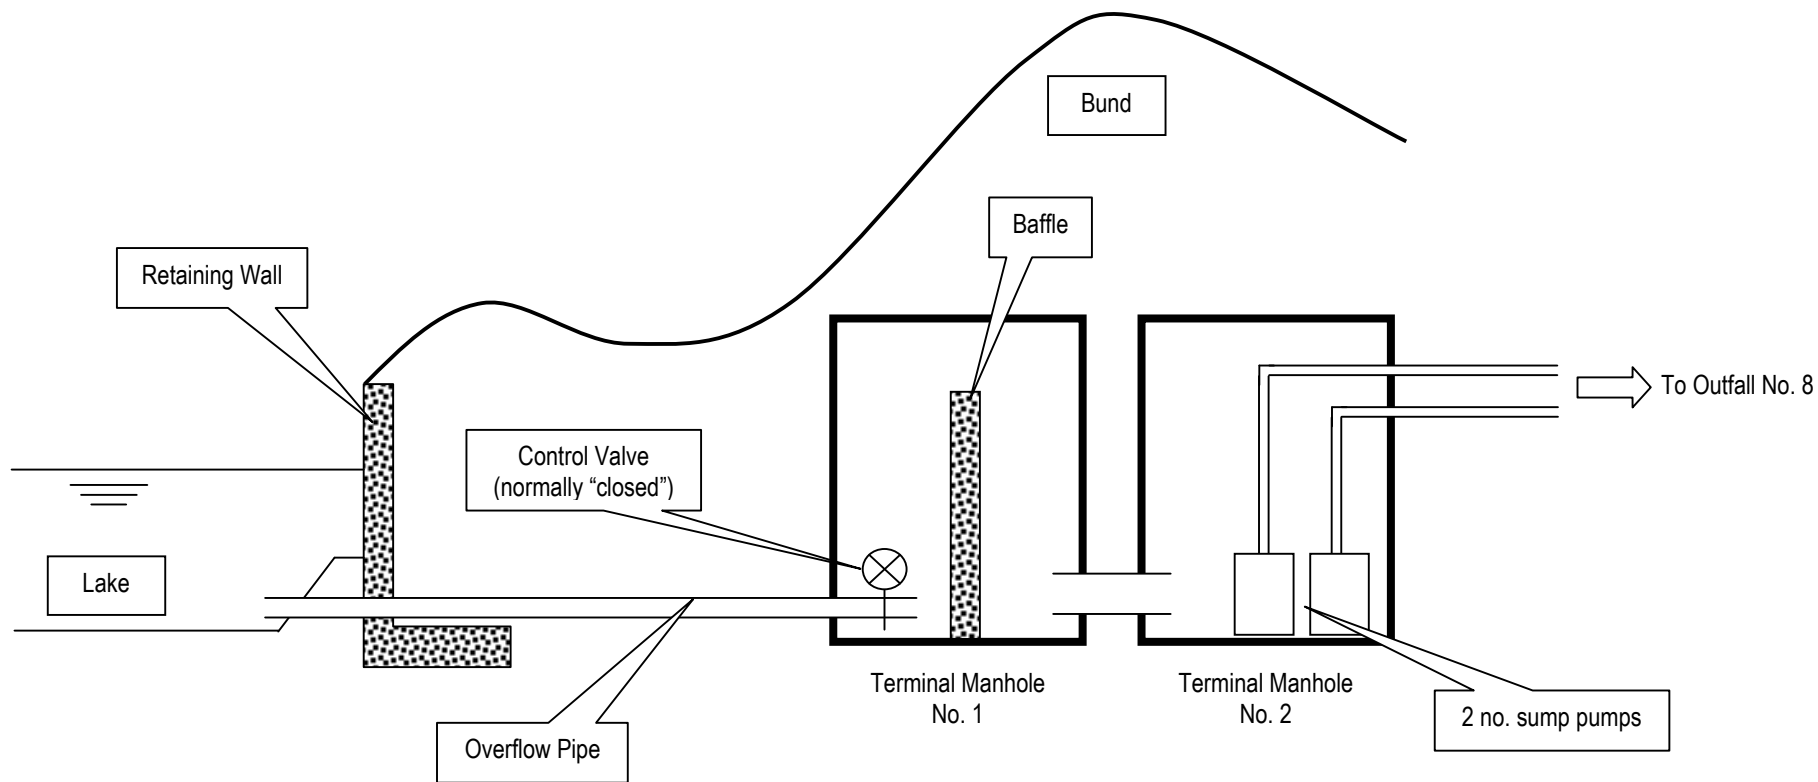


Figure 2-1 Schematic of Lake Water Control System

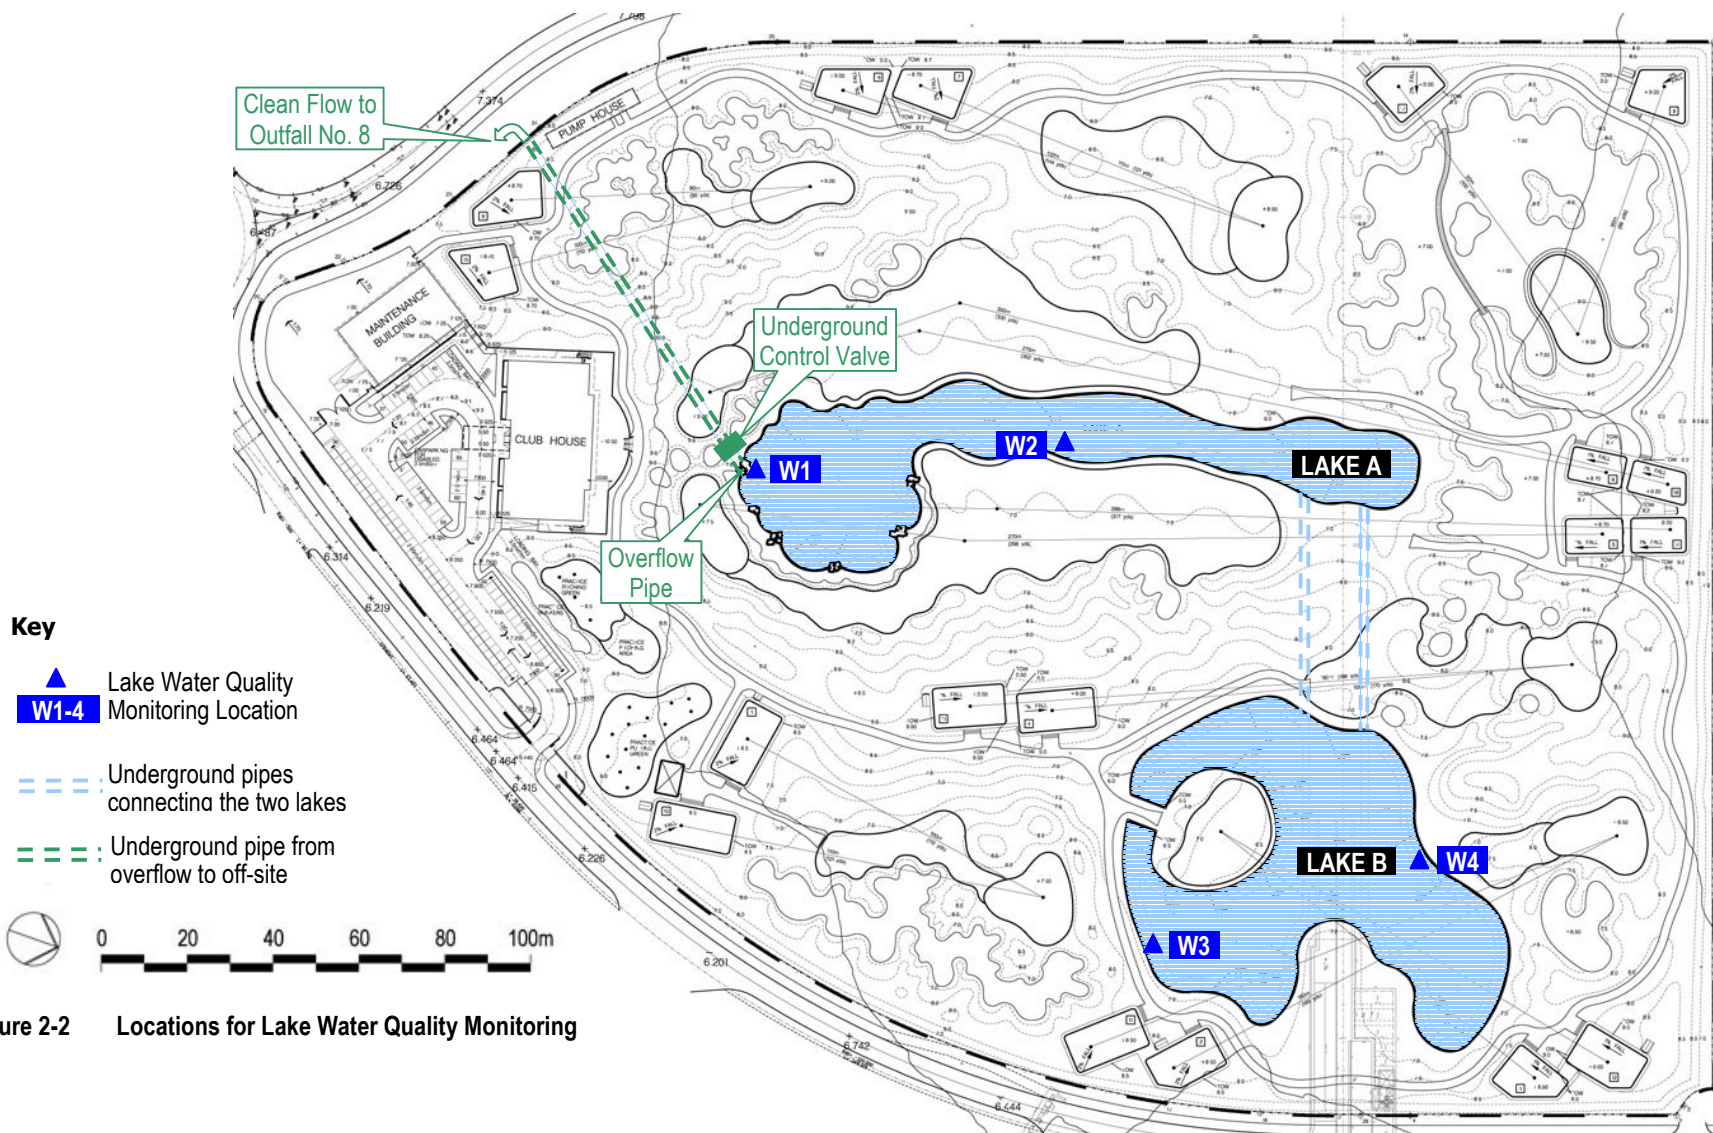


Figure 2-2 Locations for Lake Water Quality Monitoring

3 Comments, Recommendations and Conclusions

Compliance monitoring of lake water quality is required on a monthly basis. Parameters tested for include suspended solids, dissolved oxygen, BOD₅, nitrogen, phosphorous, temperature and salinity. Monthly compliance monitoring was carried out on 10 August, 14 September and 12 October 2007 at four locations within the two lakes.

Reporting during the second phase of the Operation Period is required on a quarterly basis. This is the second Quarterly Compliance report covering August to October 2007 and complies with the reporting requirements stated in the approved EM&A Manual.

During the reporting quarter, exceedances of the Action Level for SS were recorded at W3 and W4 on 12 October 2007. According to the Event Action Plan, EPD and the Golf Course Supervisor were notified as soon as the results were available and weekly monitoring of SS has been implemented until SS levels drop below the Action Level. Furthermore, the Golf Course Supervisor was immediately advised that lake water was not of an acceptable quality and that the control valve (to allow discharge of lake water) must not be opened until SS levels drop below the Action Level. The exceedances have been attributed to maintenance works of the fountain in Lake B at the time of sampling – workers were in the water and causing sediment to become suspended. As such, it is expected that the next SS monitoring results from W3 and W4 will return to normal, i.e., below the Action Level.

Although exceedances have been recorded, there has been no discharge of lake water off-site during the reporting quarter and so there have been no external environmental impacts resulting from the high SS levels.

There was no exceedance of Limit Levels for lake water quality during the reporting quarter; no complaints received; and there were no notifications of summons..



Appendix 1

Lake Water Quality Monitoring Data



Date	Time	Station	Salinity	Temperature	Suspended Solids	BOD ₅	Dissolved Oxygen Saturation	Dissolved Oxygen Concentration	Total Nitrogen	Total Phosphorous
			(mg/l)	°C	(mg/l)	(mg/l)	(%)	(mg/l)	(mg/l)	(mg/l)
10-Aug-07	12:30	W1	0.1	28.9	11.0	2.0	77.8	5.7	6.5	0.7
10-Aug-07	12:40	W2	0.1	28.8	6.0	2.0	76.5	5.2	2.0	0.1
10-Aug-07	12:50	W3	0.1	28.7	5.0	2.0	81.6	6.2	1.9	0.1
10-Aug-07	13:00	W4	0.1	29	4.0	2.0	80.3	6.0	2.0	0.1
14-Sep-07	13:30	W1	0.1	32.3	9.0	6.0	133.0	9.7	1.8	0.1
14-Sep-07	13:40	W2	0.1	32.3	10.0	6.0	133.0	9.6	1.7	0.1
14-Sep-07	13:50	W3	0.1	32.3	11.0	4.0	135.0	9.8	3.0	0.1
14-Sep-07	14:00	W4	0.1	32.3	12.0	4.0	134.0	9.7	2.8	0.1
12-Oct-07	11:30	W1	0.1	28.3	13.0	6.0	91.8	7.2	1.6	0.1
12-Oct-07	11:40	W2	0.1	28.3	13.0	7.0	96.5	7.6	1.8	0.1
12-Oct-07	11:55	W3	0.1	28.6	22.0	8.0	128.0	10.0	3.9	0.1
12-Oct-07	12:10	W4	0.1	28.6	24.0	2.0	140.0	10.9	4.7	0.1
Mean			0.1	29.9	11.7	4.3	109.0	8.1	2.8	0.2
Min			0.1	28.3	4.0	2.0	76.5	5.2	1.6	0.1
Max			0.1	32.3	24.0	8.0	140.0	10.9	6.5	0.7

Note : "n/a" indicates data is not available

Bold indicates Action Level exceedance


Bold indicates Limit Level exceedance




Appendix 2



Graphical Plots for Monitoring Results

SkyCity Golf Course Pond Water Quality Moinitoring SS at W1

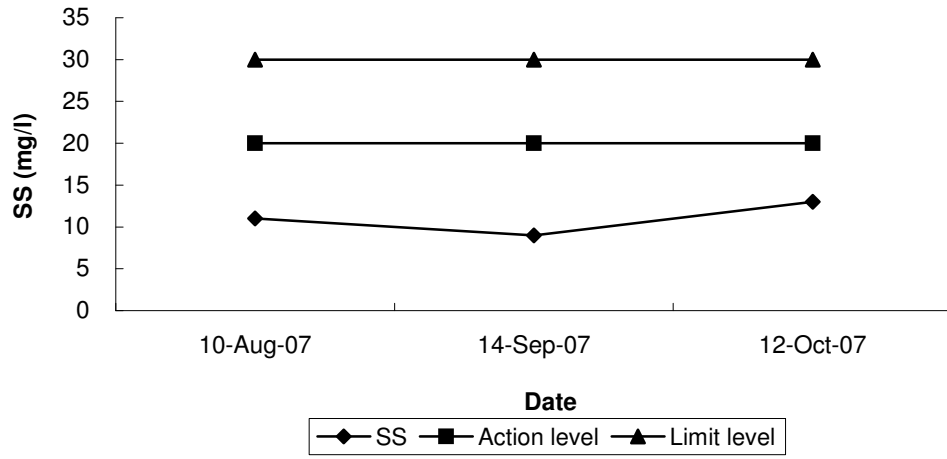


SkyCity Golf Course Pond Water Quality Moinitoring SS at W2

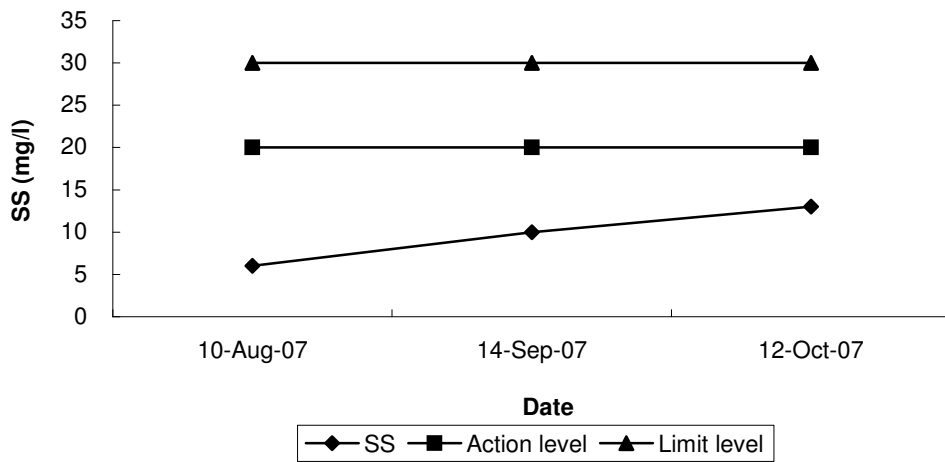


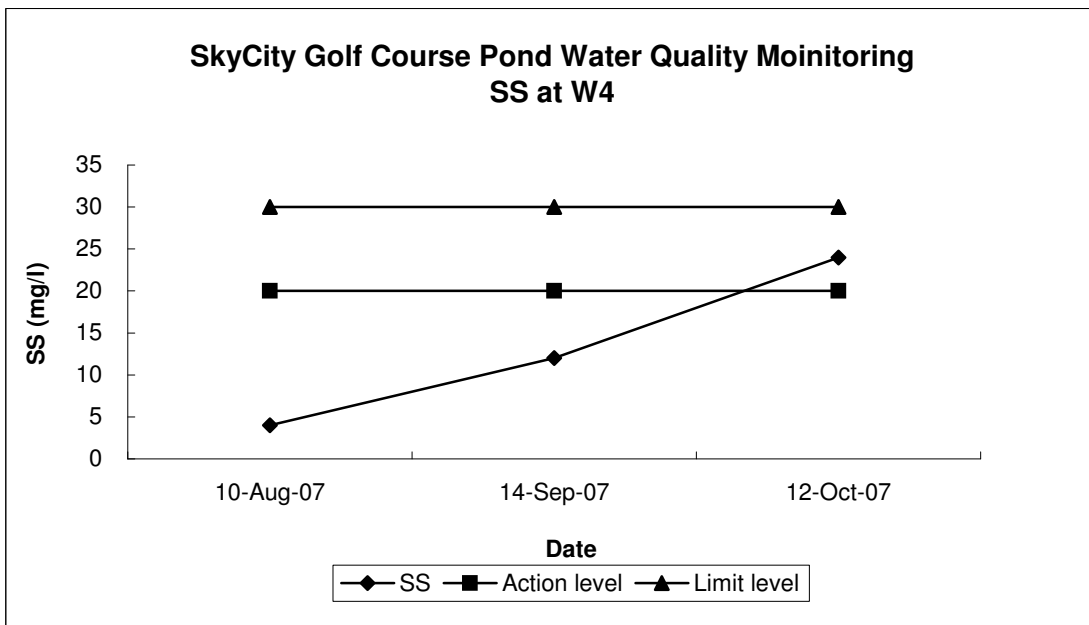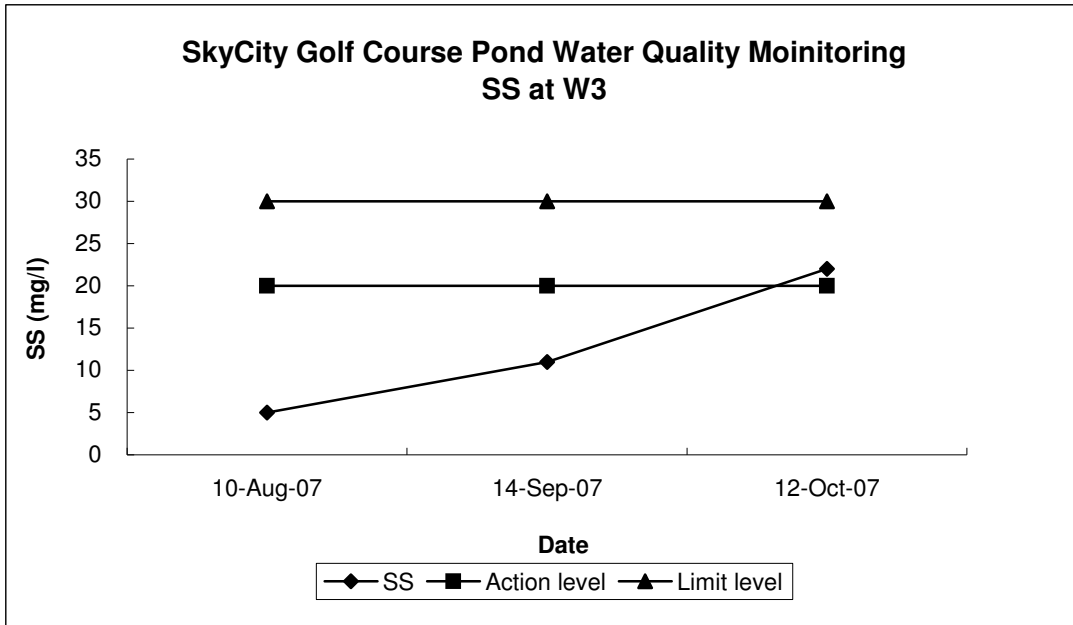


SkyCity Golf Course Pond Water Quality Moinitoring BOD5 at W1

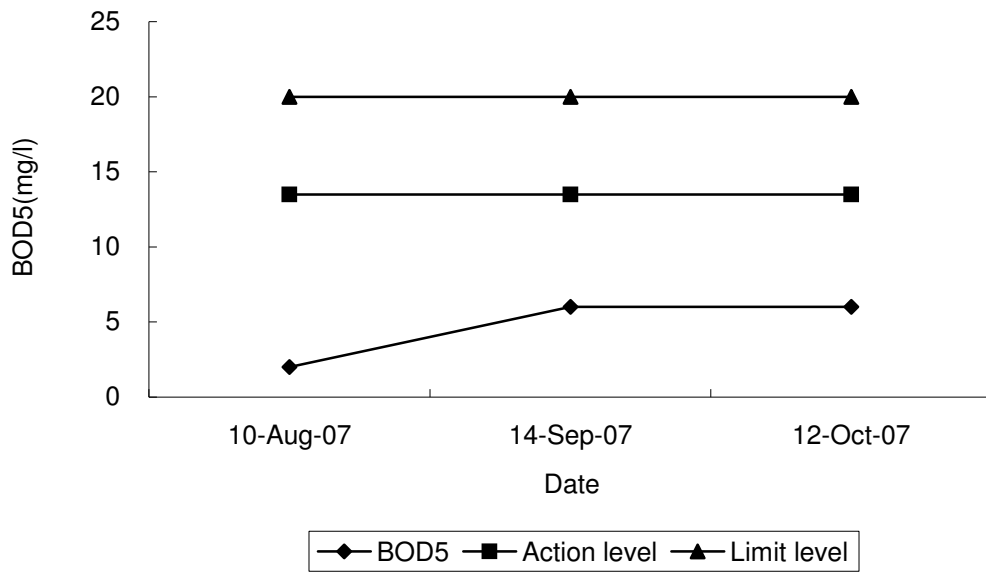


SkyCity Golf Course Pond Water Quality Moinitoring BOD₅ at W2

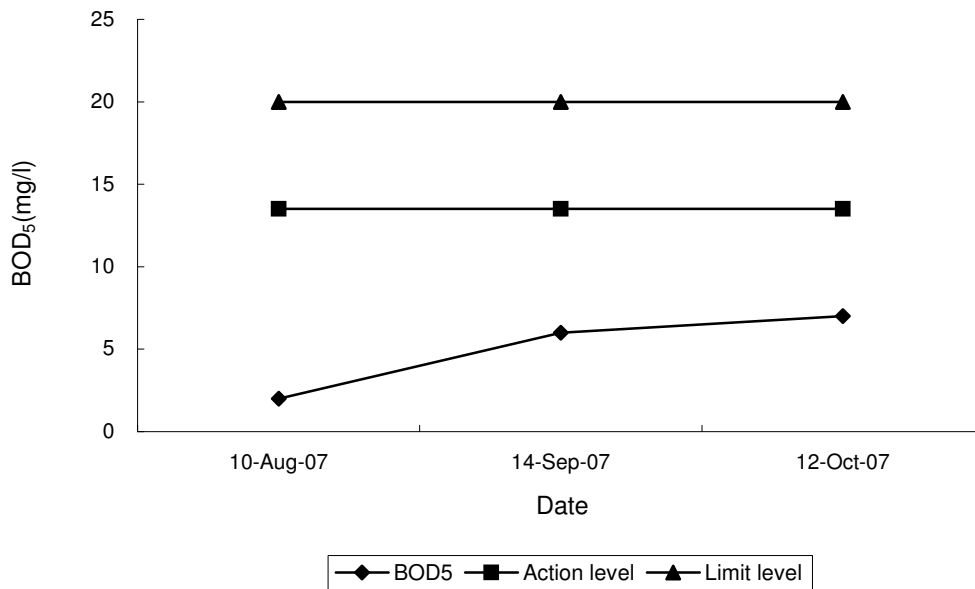


SkyCity Golf Course Pond Water Quality Moinitoring BOD₅ at W3

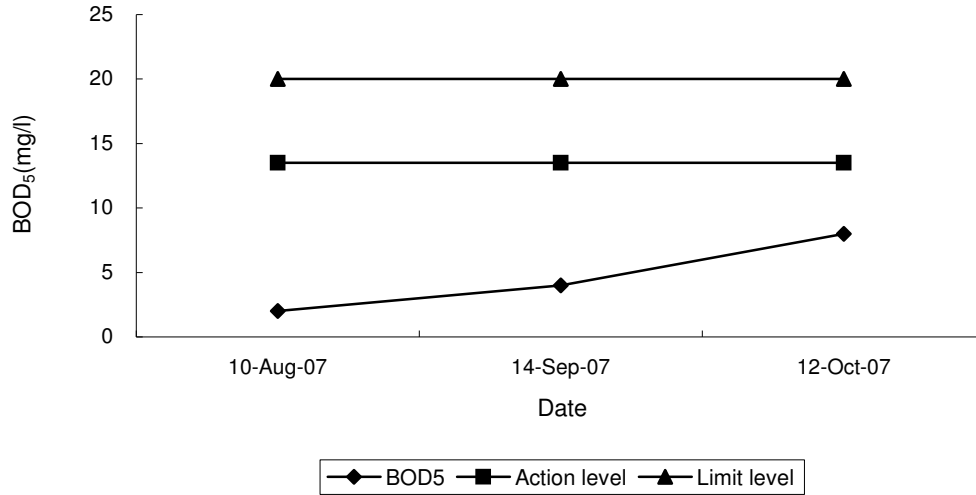


SkyCity Golf Course Pond Water Quality Moinitoring BOD₅ at W4

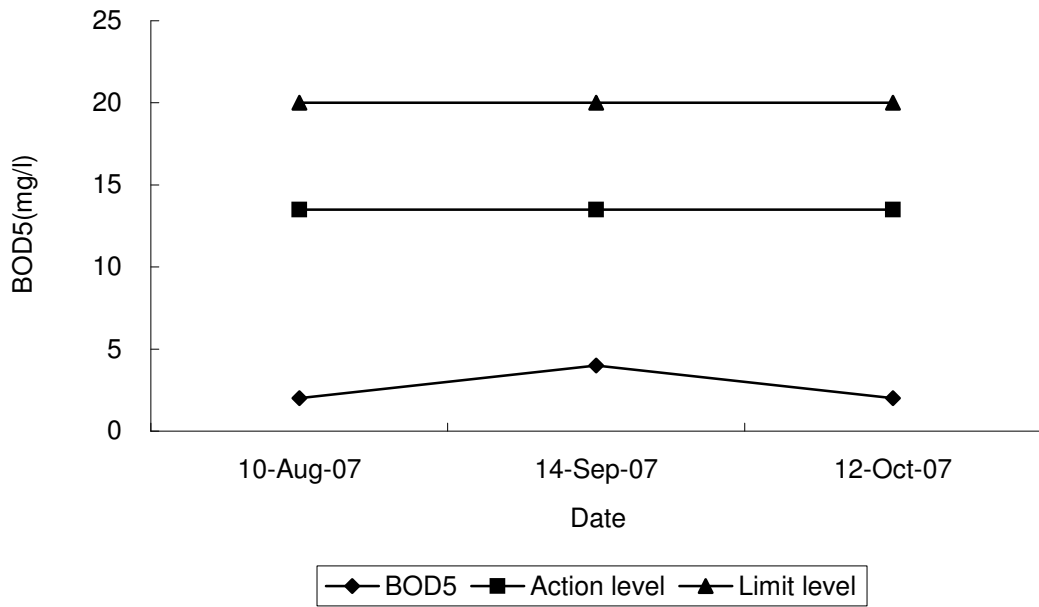


SkyCity Golf Course Pond Water Quality Moinitoring DO Concentration at W1

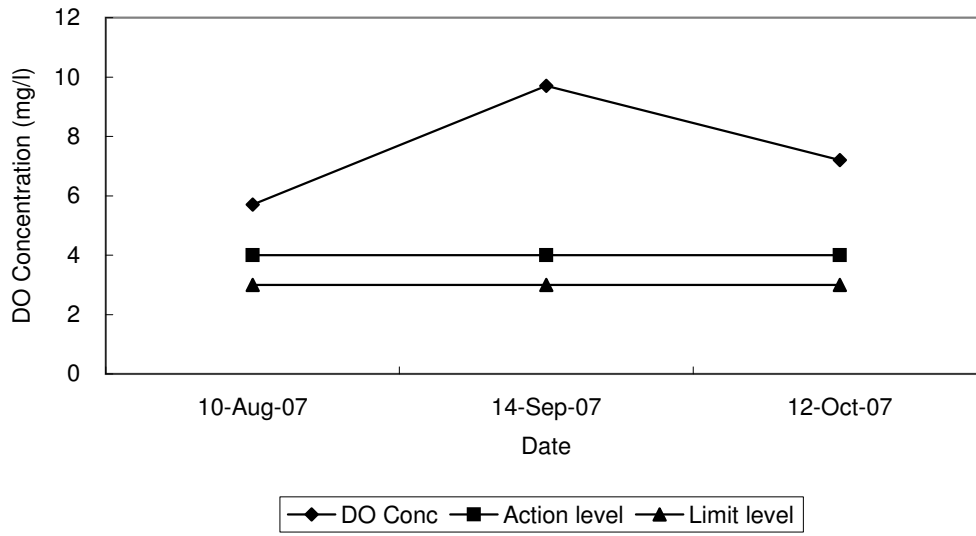


SkyCity Golf Course Pond Water Quality Moinitoring DO Concentration at W2

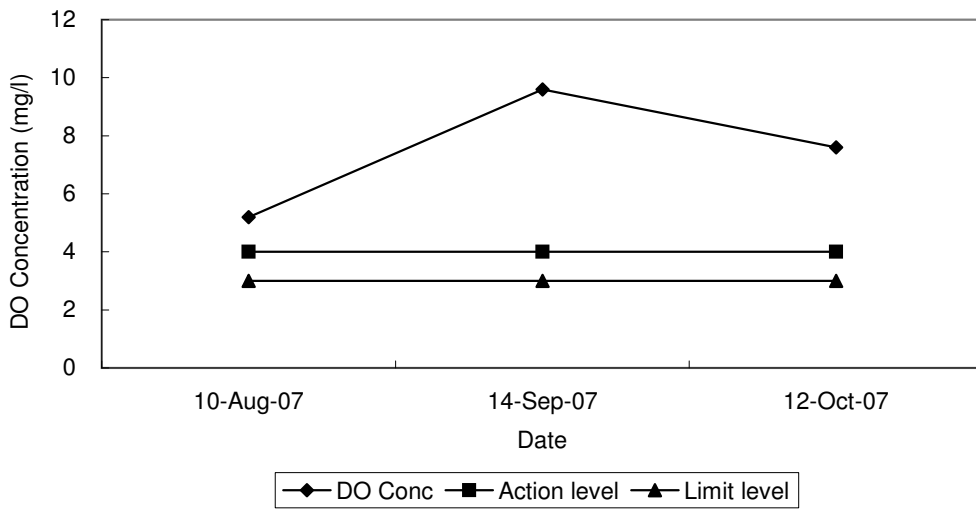


SkyCity Golf Course Pond Water Quality Moinitoring DO Concentration at W3

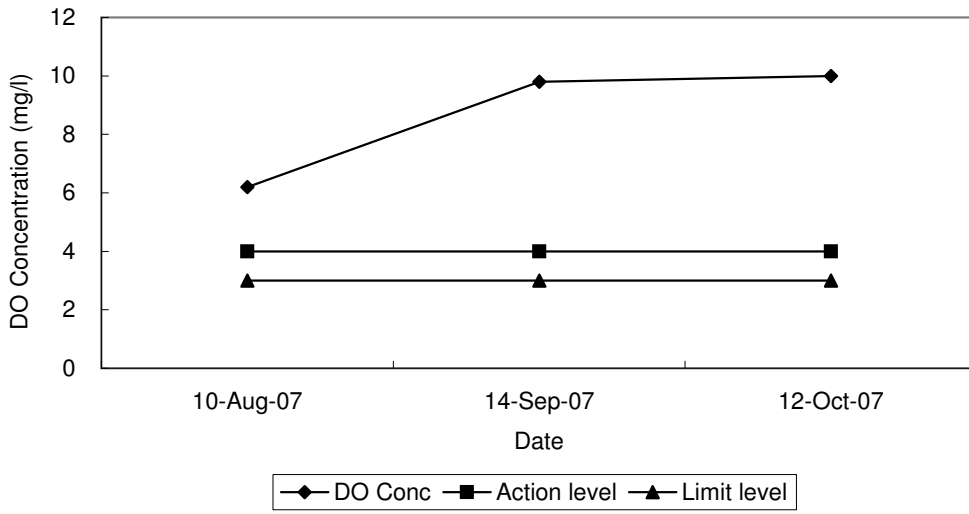


SkyCity Golf Course Pond Water Quality Moinitoring DO Concentration at W4

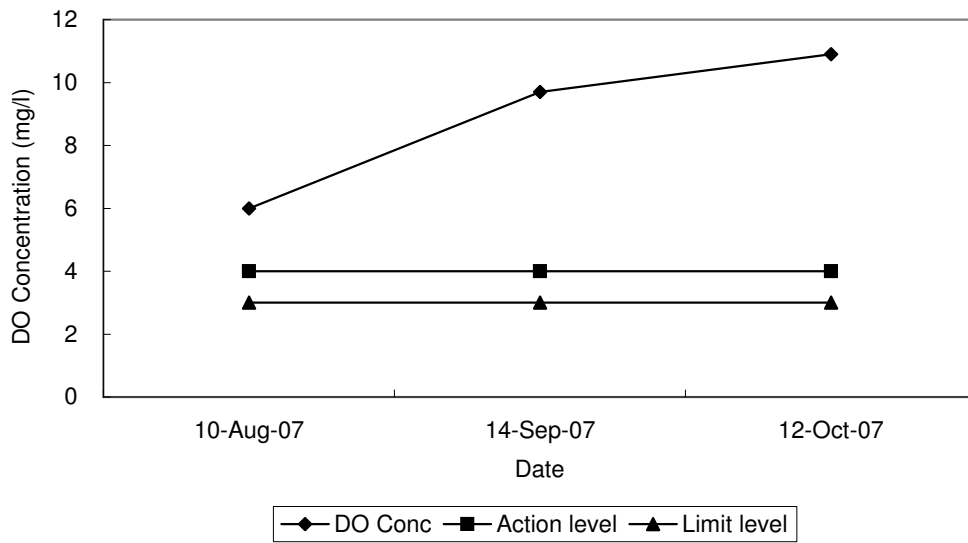


**SkyCity Golf Course Pond Water Quality Moinitoring
Total Nitrogen at W1**

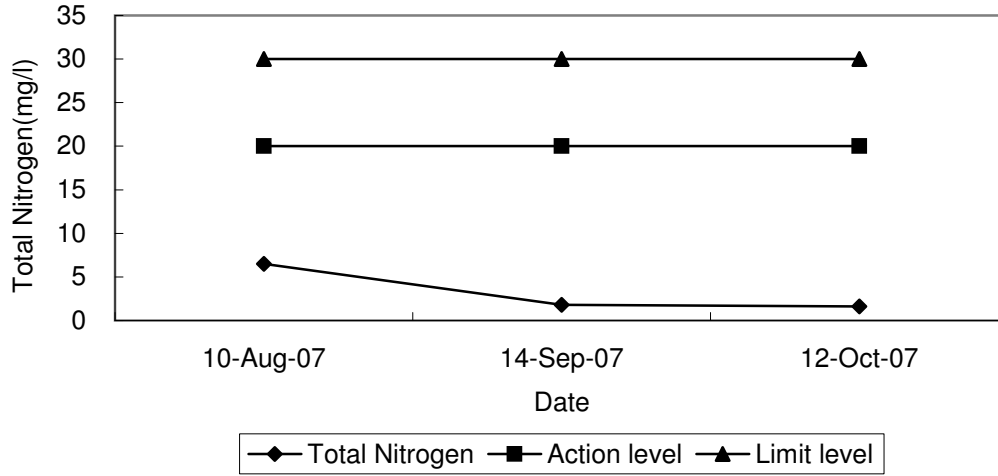


**SkyCity Golf Course Pond Water Quality Moinitoring
Total Nitrogen at W2**

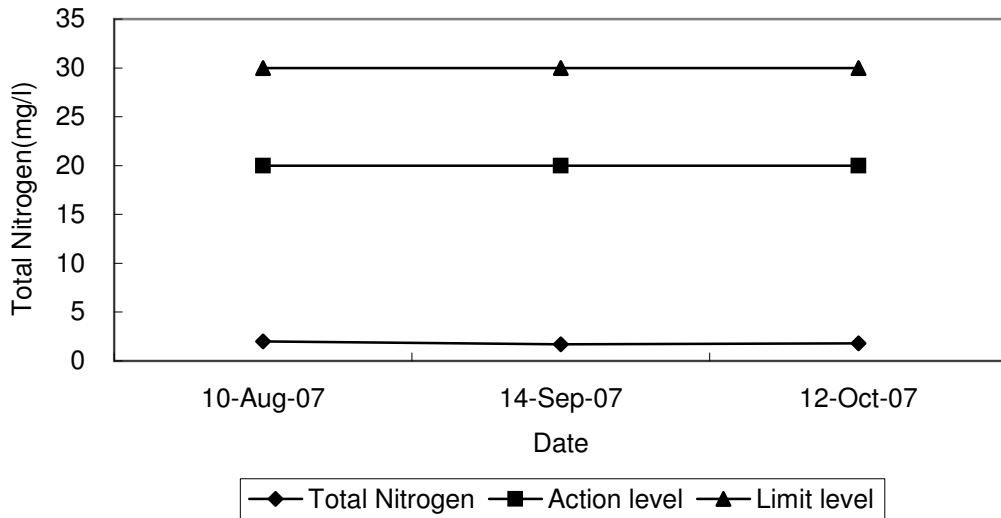


SkyCity Golf Course Pond Water Quality Moinitoring Total Nitrogen at W3

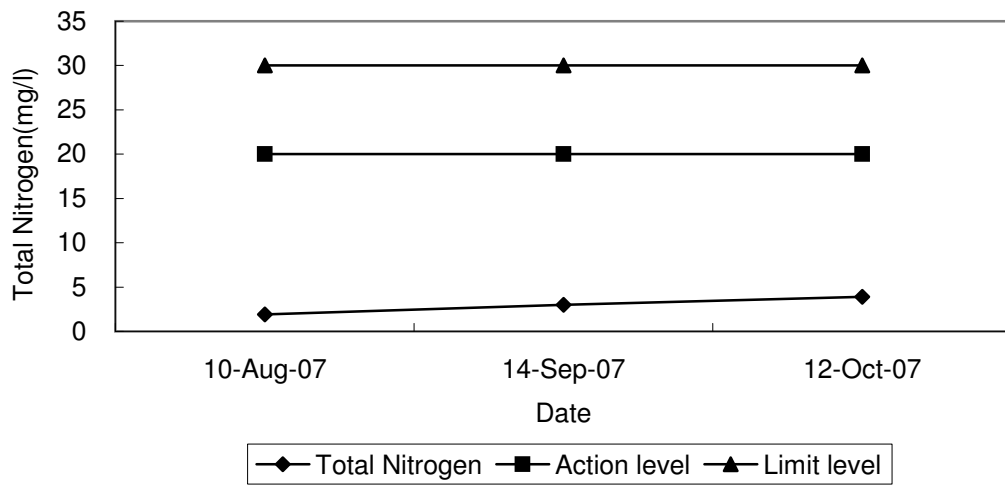


SkyCity Golf Course Pond Water Quality Moinitoring Total Nitrogen at W4

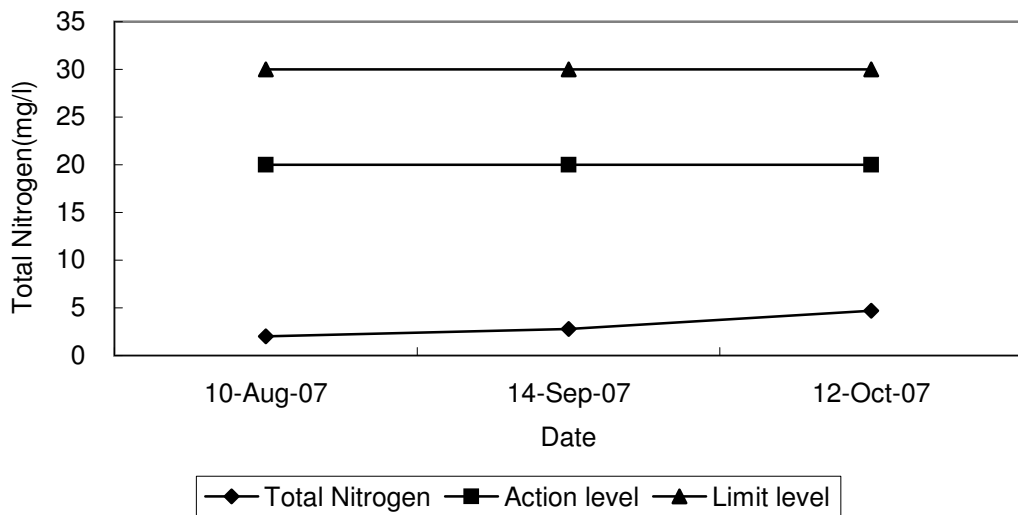


**SkyCity Golf Course Pond Water Quality Moinitoring
Total Phosphorous at W1**

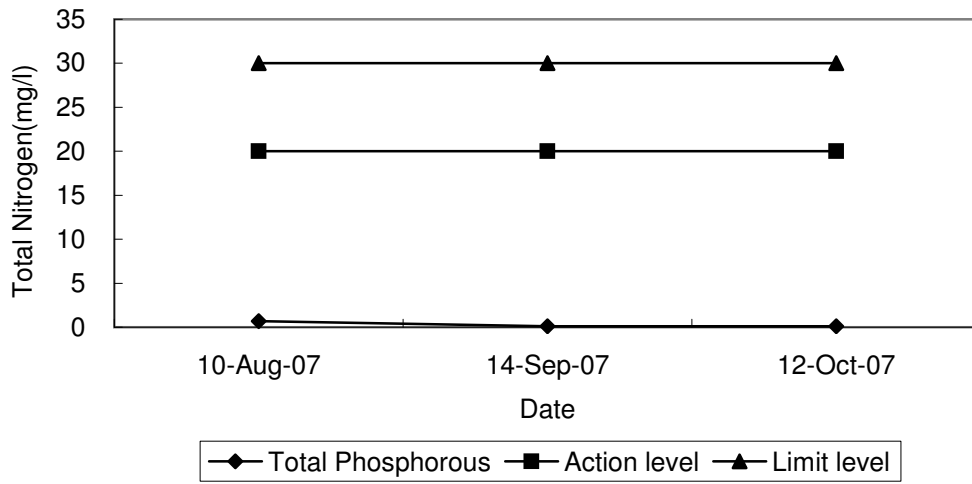


**SkyCity Golf Course Pond Water Quality Moinitoring
Total Phosphorous at W2**

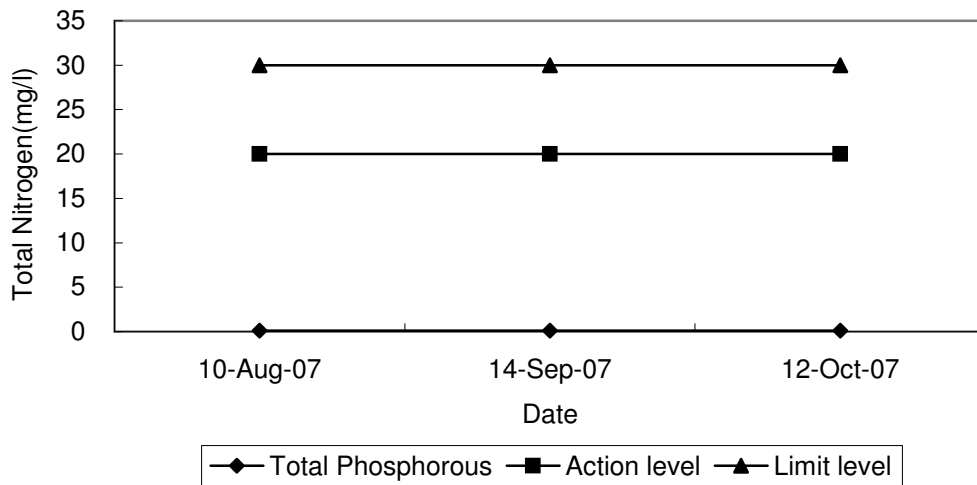

**SkyCity Golf Course Pond Water Quality Moinitoring
Total Phosphorous at W3**

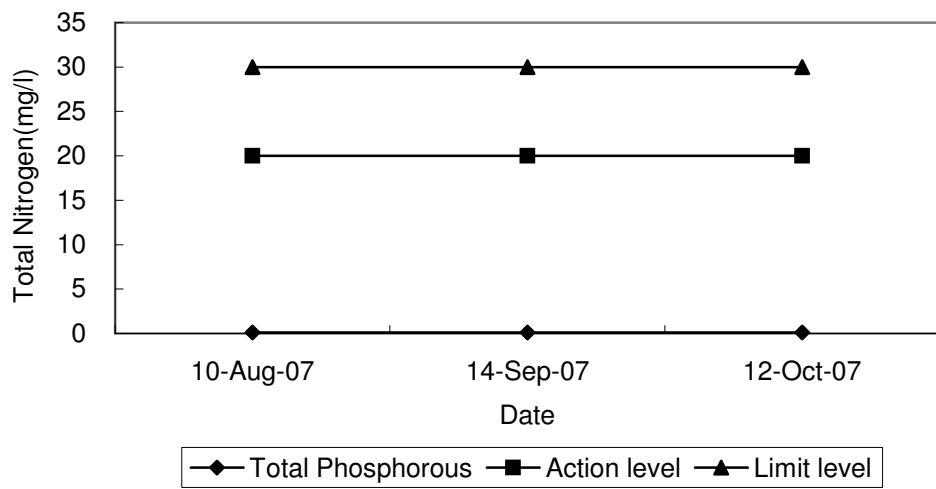

**SkyCity Golf Course Pond Water Quality Moinitoring
Total Phosphorous at W4**

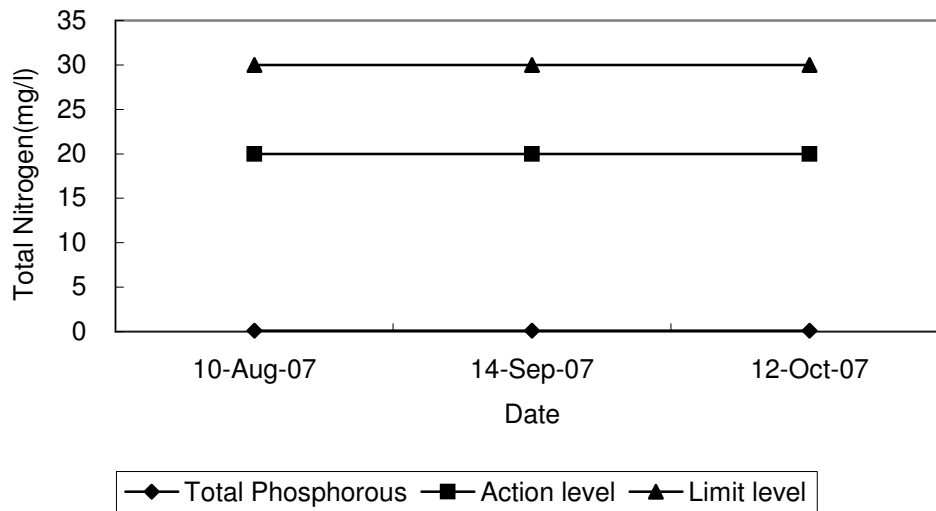



Appendix 3

Equipment Calibration Details



CERTIFICATE OF ANALYSIS

CONTACT: MS WINNIE MA
CLIENT: HYDER CONSULTING LTD
ADDRESS: 47/F, HOPEWELL CENTRE,
183 QUEEN'S ROAD EAST,
WANCHAI, HONG KONG

ORDER No.:

Batch: HK0711057
LABORATORY: HONG KONG
DATE RECEIVED: 08/08/2007
DATE OF ISSUE: 10/08/2007
SAMPLE TYPE: EQUIPMENT
No. of SAMPLES: 1

COMMENTS

The calibration procedure used for the analysis has been applied for the calibration of the above instrument.

NOTES


This is the Final Report and supersedes any preliminary report with this batch number.
Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd
11/F
Chung Shun Knitting Centre
1-3 Wing Yip Street
Kwai Chung
HONG KONG

Phone: 852-2610 1044
Fax: 852-2610 2021
Email: hongkong@alsenviro.com

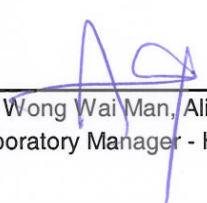
Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

Other ALS Environmental Laboratories

AUSTRALIA

Brisbane
Melbourne
Sydney
Newcastle

Hong Kong
Singapore
Kuala Lumpur
Bogor

AMERICAS

Vancouver
Santiago
Amtofagasta
Lima

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

*Abbreviations: % SPK REC denotes percentage spike recovery
CHK denotes duplicate check sample
LOR denotes limit of reporting
LCS % REC denotes Laboratory Control Sample percentage recovery*



CERTIFICATE OF ANALYSIS


Batch: HK0711057
Date of Issue: 10/08/2007
Client: HYDER CONSULTING LTD
Client Reference:

Calibration of DO System

Item : YSI Multimeter
Model No. : YSI 85
Serial No. : 01J0362
Equipment No.: HK065
Calibration Method : This meter was calibrated in accordance with standard method APHA (18th Ed.) 4500-OC & G
Date of Calibration : 08 August, 2007

Testing Results :

Expected Reading	Recording Reading
0.00 mg/L	0.00 mg/L
2.78 mg/L	2.71 mg/L
5.43 mg/L	5.35 mg/L
7.81 mg/L	7.79 mg/L
Allowing Deviation	±0.2 mg/L

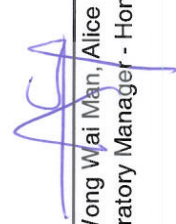
 Ms Wong Wai Man, Alice
 Laboratory Manager - Hong Kong



CERTIFICATE OF ANALYSIS

CONTACT: MS WINNIE MA
CLIENT: HYDER CONSULTING LTD
ADDRESS: 47/F, HOPEWELL CENTRE,
183 QUEEN'S ROAD EAST,
WANCHAI, HONG KONG

Batch: HK0713726
LABORATORY: HONG KONG
DATE RECEIVED: 13/09/2007
DATE OF ISSUE: 03/10/2007
SAMPLE TYPE: EQUIPMENT
No. of SAMPLES: 1

ORDER No.:

COMMENTS

The calibration procedure used for the analysis has been applied for the calibration of the above instrument.

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.
Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd
11/F
Chung Shun Knitting Centre
1-3 Wing Yip Street
Kwai Chung
HONG KONG

Phone: 852-2610 1044
Fax: 852-2610 2021
Email: hongkong@alsenviro.com



Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

Other ALS Environmental Laboratories

AUSTRALIA		AMERICAS
Brisbane	Hong Kong	Vancouver
Melbourne	Singapore	Santiago
Sydney	Kuala Lumpur	Amtofagasta
Newcastle	Bogor	Lima

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

*Abbreviations: % SPK REC denotes percentage spike recovery
CHK denotes duplicate check sample
LOR denotes limit of reporting
LCS % REC denotes Laboratory Control Sample percentage recovery*



CERTIFICATE OF ANALYSIS


Batch: HK0713726
Date of Issue: 03/10/2007
Client: HYDER CONSULTING LTD
Client Reference:

Calibration of DO System

Item : YSI Multimeter
Model No. : YSI 85
Serial No. : 01J0362
Equipment No.: HK065
Calibration Method : This meter was calibrated in accordance with standard method APHA (18th Ed.) 4500-OC & G
Date of Calibration : 13 September, 2007

Testing Results :

Expected Reading	Recording Reading
0.00 mg/L	0.00 mg/L
3.89 mg/L	4.08 mg/L
5.34 mg/L	5.46 mg/L
7.76 mg/L	7.64 mg/L
Allowing Deviation	±0.2 mg/L


 Ms Wong Wai Man, Alice
 Laboratory Manager - Hong Kong



CERTIFICATE OF ANALYSIS

CONTACT: MS WINNIE MA
CLIENT: HYDER CONSULTING LTD
ADDRESS: 47/F, HOPEWELL CENTRE,
183 QUEEN'S ROAD EAST,
WANCHAI, HONG KONG

ORDER No.:

Batch: HK0714899
LABORATORY: HONG KONG
DATE RECEIVED: 11/10/2007
DATE OF ISSUE: 15/10/2007
SAMPLE TYPE: EQUIPMENT
No. of SAMPLES: 1

COMMENTS

The calibration procedure used for the analysis has been applied for the calibration of the above instrument.

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.
Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd
11/F
Chung Shun Knitting Centre
1-3 Wing Yip Street
Kwai Chung
HONG KONG

Phone: 852-2610 1044
Fax: 852-2610 2021
Email: hongkong@alsenviro.com


Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

Other ALS Environmental Laboratories

AUSTRALIA

Brisbane
Melbourne
Sydney
Newcastle

Hong Kong
Singapore
Kuala Lumpur
Bogor

AMERICAS

Vancouver
Santiago
Amtofagasta
Lima

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

*Abbreviations: % SPK REC denotes percentage spike recovery
CHK denotes duplicate check sample
LOR denotes limit of reporting
LCS % REC denotes Laboratory Control Sample percentage recovery*



CERTIFICATE OF ANALYSIS


Batch: HK0714899
Date of Issue: 15/10/2007
Client: HYDER CONSULTING LTD
Client Reference:

Calibration of DO System

Item : YSI Multimeter
Model No. : YSI 85
Serial No. : 01J0362
Equipment No.: HK065
Calibration Method : This meter was calibrated in accordance with standard method APHA (18th Ed.) 4500-OC & G
Date of Calibration : 11 October, 2007

Testing Results :

Expected Reading	Recording Reading
0.00 mg/L	0.00 mg/L
3.03 mg/L	3.13 mg/L
4.44 mg/L	4.29 mg/L
7.47 mg/L	7.52 mg/L
Allowing Deviation	±0.2 mg/L


 Ms Wong Wai Man, Alice
 Laboratory Manager - Hong Kong