

Highways Department


Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin

Contract No. HY/2003/10 - Environmental Team for
Lai Chi Kok Viaduct and Eagle's Nest Tunnel

Monthly EM&A Report
Part II – Eagle's Nest Tunnel & Associated Works
(Version 1.0)

February 2008

Approved By

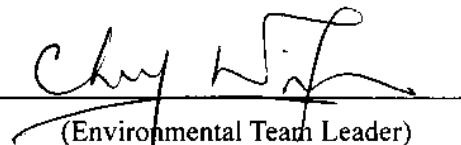

(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties.

CINOTECH CONSULTANTS LTD

Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong
Tel: (852) 2151 2083 Fax: (852) 3107 1388
Email: info@cinotech.com.hk

TABLE OF CONTENTS

EXECUTIVE SUMMARY	I
Introduction.....	1
Environmental Monitoring and Audit Works	1
Environmental Licenses and Permits.....	2
Key Information in the Reporting Month.....	2
1. INTRODUCTION.....	3
Background.....	3
Project Organizations.....	4
Construction Programme	4
Summary of EM&A Requirements	5
2. AIR QUALITY	6
Monitoring Requirements	6
Monitoring Locations	6
Monitoring Equipment.....	6
Monitoring Parameters, Frequency and Duration	6
Monitoring Methodology and QA/QC Procedure	7
Results and Observations.....	8
3. NOISE	9
Monitoring Requirements	9
Monitoring Locations	9
Monitoring Equipment.....	10
Monitoring Parameters, Frequency and Duration	10
Monitoring Methodology and QA/QC Procedures.....	10
Maintenance and Calibration.....	11
Results and Observations.....	11
4. ENVIRONMENTAL AUDIT	12
Site Audits	12
Review of Environmental Monitoring Procedures	12
Status of Environmental Licensing and Permitting	12
Implementation Status of Environmental Mitigation Measures.....	12
Summary of Exceedances	15
Implementation Status of Event Action Plans	15
Summary of Complaints and Prosecutions.....	15
5. FUTURE KEY ISSUES	16
Key Issues for the Coming Month.....	16
Monitoring Schedule for the Next Month	16
Construction Program for the Next Month.....	16
6. CONCLUSIONS AND RECOMMENDATIONS	18
Conclusions.....	18
Recommendations.....	18

LIST OF TABLES

Table I	Summary Table for Events Recorded in the Reporting Month
Table II	Summary Table for Key Information in the Reporting Month
Table 1.1	Key Project Contacts
Table 2.1	Locations for Air Quality Monitoring
Table 2.2	Air Quality Monitoring Equipment
Table 2.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 3.1	Noise Monitoring Stations
Table 3.2	Noise Monitoring Equipment
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 4.1	Summary of Environmental Licensing and Permit Status
Table 4.2	Observations and Recommendations of Site Audit
Table 4.3	Observations and Recommendations of Site Audits Followed up for Pervious Month for Civil Works

LIST OF FIGURES

Figure 1a	Locations of Monitoring Stations
Figure 1b	Locations of Monitoring Stations

LIST OF APPENDICES

A	Action and Limit Levels for Air Quality and Noise
B	Copies of Calibration Certificates
C	Environmental Monitoring Schedules
D	Wind Data
E	1-hour TSP Monitoring Results and Graphical Presentations
F	24-hour TSP Monitoring Results and Graphical Presentations
G	Noise Monitoring Results and Graphical Presentations
H	Summary of Exceedance
I	Site Audit Summary
J	Event Action Plans
K	Environmental Mitigation Implementation Schedule (EMIS)
L	Construction Programme
M	Complaint Log

ABBREVIATION AND ACRONYM

AL Levels	Action and Limit Levels
E / ER	Engineer/Engineer's Representative
EIA	Environmental Impact Assessment
EM&A	Environmental Monitoring and Audit
EMIS	Environmental Mitigation Implementation Schedule
EP	Environmental Permit
EPD	Environmental Protection Department
ET	Environmental Team
HVS	High Volume Sampler
IEC	Independent Environmental Checker
RE	Resident Engineer
RH	Relative Humidity
TSP	Total Suspended Particulates
TDD	Territory Development Department
QA/QC	Quality Assurance / Quality Control
SLM	Sound Level Meter
WMP	Waste Management Plan

EXECUTIVE SUMMARY**Introduction**

- This is the 51st monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the “Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin, Lai Chi Kok Viaduct & Eagle’s Nest Tunnel”. This report documents the findings of EM&A Works conducted in February 2008 for Contract No. HY/2003/02, Eagle’s Nest Tunnel and Associated Works (the Project).
- The major site activities for civil works undertaken in the reporting month included:
 - Cladding and Hand Rail Installation;
 - Tunnel Ventilation System and Lighting (T&C);
 - Plumbing & Drainage;
 - Mechanical Ventilation Air Conditioning and T&C;
 - Road works;
 - Metal mesh cladding;
 - Tiling and Upper roof railing;
 - Fencing at Ventilation Building;
 - Testing on fire services and lighting;
 - False and external metal ceiling, painting, hand rail installation on roof and signages at Toll Plaza’s structures & Administration Building; and
 - U-channel, stepped channel, fill slope at SP-S2, irrigation pipe and system (T&C) and lighting for noise enclosure at Butterfly Valley.
- The major site activities for Traffic Control and Surveillance System (TCSS) works undertaken in the reporting month included:
 - Site Acceptance Tests (SAT) for TCSS equipment.

Environmental Monitoring and Audit Works

- Environmental monitoring and audit works for the Project was performed regularly as stipulated in the EM&A Manual and the results were checked and reviewed. Site audits were conducted once per week. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
- Summary of events and actions taken in the reporting month is tabulated in **Table I**.

Table I Summary of Events Recorded in the Reporting Month

<i>Parameter</i>	<i>No. of Events</i>		<i>No. of Events Due to the Project</i>	<i>Action Taken</i>
	<i>Action Level</i>	<i>Limit Level</i>		
1-hr TSP	0	0	0	N/A
24-hr TSP	0	0	0	N/A
Noise	0	0	0	N/A

Environmental Licenses and Permits

- Licenses/Permits granted to the Project include the Environmental Permit (EP) for the Project, Registration of Chemical Waste Producer (RCWP), Construction Noise Permits (CNP) and Water Discharge Licenses (WDLs). No new CNP was issued to the Project by EPD in the reporting month.

Key Information in the Reporting Month

- Summary of key information in this reporting month is tabulated in **Table II**.

Table II Summary Table for Key Information in the Reporting Month

Event	Event Details		Action Taken	Status	Remark
	Number	Nature			
Complaint received	0	---	N/A	N/A	---
Changes to the assumptions and key construction / operation activities recorded	0	---	N/A	N/A	---
Status of submissions under EP	0	---	N/A	N/A	---
Notifications of any summons & prosecutions received	0	---	N/A	N/A	---
<u>Future Key Issues:</u>					
Major site activities for civil works in the coming months include:					
<ul style="list-style-type: none"> Hand Rail Installation; Metal Mesh Cladding; Tunnel Ventilation System (T&C); Plumbing & Drainage (T&C); Mechanical Ventilation Air Conditioning (T&C); Roof tiles; Boundary Fencing; Slope Fencing; Fire services (T&C); Irrigation pipe & system (T&C); Re-created stream (DSD Access Rd); and 7m Noise Barrier (Mesh Panel) at Butterfly Valley. 					
Major site activities for TCSS works in the coming months include:					
<ul style="list-style-type: none"> Site Acceptance Tests (SAT) for TCSS equipment. 					
The anticipated environmental issues will be mainly on general refuse generated from fencing, cladding and handrail installation works; and noise nuisance from erection of 7m Noise Barrier.					

1. INTRODUCTION

Background

- 1.1 Route 9 (Kowloon Section) (R9K) (hereinafter call the R9K-Project) forms part of the Route 9 between Cheung Sha Wan and Sha Tin (R9-CSWST) project, which will be a new expressway connecting West Kowloon and Sha Tin. It will be the fourth external link between Sha Tin and Kowloon and will form an important link between the northeast New Territories and the west Kowloon, Lantau Island and the western New Territories. R9K is being managed and implemented by the Highways Department (HyD).
- 1.2 The engineering design of R9K is covered under Agreement No. CE 50/98 "Route 9 between Cheung Sha Wan and Sha Tin – Design Construction Assignment". The main consultant engaged under Agreement No. CE 50/98 is Maunsell Hyder Joint Venture (MHJV), who acts as the Engineer for the construction contracts. The works of R9K mainly comprise a 1.4km dual 3-lane Lai Chi Kok Viaduct from Lai Wan Interchange to Butterfly Valley; 0.5 km of dual 3-lane at-grade carriageway linking to the 2.1 km dual 3-lane twin-bore Eagle's Nest Tunnel with associated portal buildings; a toll plaza with an administration building located with the Sha Tin valley woodland; a ventilation building and an adit; associated noise barriers, noise enclosures, drainage, slope and landscape works; and electrical and mechanical works for the whole R9-CSWST. The remainder of the R9-CSWST forms the Sha Tin Section (R9S) of the project and is being managed and implemented separately by the Civil Engineering and Development Department (CEDD).
- 1.3 The R9-CSWST project is a Designated Project under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO). An environmental impact assessment (EIA) report has been prepared in 1998 for the R9-CSWST project (1998 R9 EIA) to consider the key issues of noise, air quality, water quality, ecological, construction waste, landscape and visual, land use and cultural impacts, and identify possible mitigation measures.
- 1.4 An Updated Final EIA report was subsequently completed in September 1999 for the R9-CSWST project (1999 R9 EIA), to cater for some changes in R9K portion as mentioned in paragraph 1 of the report. The 1999 R9 EIA was endorsed by Environmental Protection Department (EPD) in November 1999. The 1998 R9 EIA and the 1999 R9 EIA (R9 EIA Reports) were included in the EIA register under the EIAO as report no. EIA-135/BC and AEIAR-022/1999 respectively. An Environmental Monitoring and Audit (EM&A) Manuals for each of the R9 EIA Reports (EM&A Manuals) were also included as part of the EIA reports in the register.
- 1.5 Subsequent to the endorsement of the R9 EIA Reports by EPD in November 1999, the project programme was deferred to start in 2002/2003 for completion by 2006/07. The implementation of the project was then separated into the R9S and R9K portion. An Environmental Permit (EP) No. EP-103/2001 was issued on 17 September 2001 for R9K to the HyD as Permit Holder and a varied EP No. EP-103/2001/C was subsequently issued on 22 July 2005.
- 1.6 The major construction activities of two civil contracts of the R9K project, Contract No. HY/2003/01 entitled "Route 9 – Lai Chi Kok Viaduct" and Contract No.

HY/2003/02 entitled “Route 9 – Eagle’s Nest Tunnel and Associated Works”, were commenced on 15th December 2003 for completion in April 2007.

- 1.7 “Route 9” was recently re-tiled as “Route 8 (previously known as Route 9)”. Cinotech Consultants Limited (Cinotech) was commissioned by HyD to undertake the Environmental Monitoring and Audit works for “Route 8 (previously known as Route 9) between Cheung Sha Wan and Sha Tin - Environmental Team (ET) for Lai Chi Kok Viaduct and Eagle’s Nest Tunnel (Contract No. HY/2003/10)”. Dr. Priscilla CHOY of Cinotech Consultants Ltd. was appointed as the ET Leader under Condition 2.2 of the EP. Mr. Damien Ku of CH2M HILL Hong Kong Ltd. was appointed as the IEC under Condition 2.1 of the EP. This is the 51st monthly EM&A report summarizing the EM&A works for the Project in February 2008.

Project Organizations

- 1.8 Different parties with different levels of involvement in the project organization include:
- Project Proponent – Major Works Project Management Office (MWPMO) of Highways Department (HyD)
 - Engineer / Engineer’s Representative (E/ER) – Maunsell-Hyder Joint Venture (MHJV)
 - Environmental Team (ET) – Cinotech Consultants Limited
 - Independent Environmental Checker (IEC) – CH2M HILL Hong Kong Ltd
 - Contractor – Leighton-Kumagai Joint Venture (LKJV)
 - Engineer’s Representative for TCSS works – Ove Arup & Partners Hong Kong Limited
 - Contractor for TCSS works – Delcan-Imtech-Gtech Joint Venture
- 1.9 The responsibilities of respective parties are detailed in Section 1.8.3 of the EM&A Manual (1999) of the Project.
- 1.10 The key contacts of the Project are shown in **Table 1.1**.

Construction Programme

The major site activities for civil works undertaken in the reporting month included Cladding & Hand Rail Installation; T&C on Tunnel Ventilation System and Lighting; Plumbing & Drainage; Mechanical Ventilation Air Conditioning and T&C; Road Works; Metal mesh cladding; tiling and upper roof railing; fencing at ventilation building; testing on fire services and lighting; false and external metal ceiling, painting, hand rail installation on roof and signages at Toll Plaza’s structures & Administration Building; and u-channel, stepped channel fill slope at SP-S2, T&C on irrigation pipe and system and lighting for noise enclosure at Butterfly Valley.

- 1.11 The major site activities for TCSS works undertaken in the reporting month included:
- Site Acceptance Tests (SAT) for TCSS equipment.

Table 1.1 Key Project Contacts

Party	Role	Name	Position	Phone No.	Fax No.
HyD	Permit Holder	Mr. Kroc Leung	SE2/R8K	2762 3662	2714 5198
		Mr. George Law	E4/R8K	2762 3675	
MHJV	Engineer	Mr. Conrad Ng	Project Manager	2605 6262	2691 2649
	Engineer's Representative	Mr. Peter Poon	CRE	3552 2500	2743 9200
		Mr. Eric Wong	RE (S & EP)	3552 2551	
		Ms. Sammie Chan	TO (EN)	3552 2605	
Cinotech	Environmental Team	Dr. Priscilla Choy	ET Leader	2151 2089	3107 1388
		Mr. Robert Tsang	Audit Team Leader and Project Coordinator	2151 2095	
		Mr. Henry Leung	Monitoring Team Leader	2151 2087	
CH2M	Independent Environmental Checker	Mr. Damien Ku	Independent Environmental Checker	2872 2921	2507 2293
		Mr. Simon Lam	Assistant Independent Environmental Checker	2872 2946	
LKJV	Contractor	Mr. Ray Brewster	Project Director	9092 6128	2743 1600
		Mr. W. C. Lam	QA/E Engineer	3552 2134	
ARUP	Engineer's Representative (TCSS)	Mr. Donald Leung	RE	2436 7489	2436 1803
		Mr. Daniel So	ARE	2436 7435	
DIGJV	Contractor (TCSS)	Ms. Joyce Chan	Quality Manager	2123 0845	2123 0889
Enquiries Hotline				3552 2226	-
Complaint Hotline				3552 2380	-

Summary of EM&A Requirements

- 1.12 The EM&A programme requires construction phase monitoring for air quality and construction noise, and environmental site audit. The EM&A requirements for each parameter are described in the following sections, including:
- All monitoring parameters;
 - Action and Limit levels for all environmental parameters;
 - Event / Action Plans;
 - Environmental mitigation measures, as recommended in the project EIA study final report; and
 - Environmental requirements in contract documents.
- 1.13 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 4 of this report.
- 1.14 This report presents the monitoring results, observations, locations, equipment, period, methodology and QA/QC procedures of the required monitoring parameters, namely dust and noise levels and audit works for the Project in the reporting month.

2. AIR QUALITY

Monitoring Requirements

- 2.1 Monitoring of 1-hour and 24-hour TSP were conducted to monitor the air quality. The established Action/Limit Levels for the environmental monitoring works were shown in **Appendix A**.

Monitoring Locations

- 2.2 Three designated monitoring stations, AM1, AM3 and AM4 were selected for impact dust monitoring for the Project. **Table 2.1** describes the air quality monitoring locations, which are also depicted in **Figure 1a** and **1b**.

Table 2.1 Locations for Air Quality Monitoring

Station	Description	Location
AM1 ⁽¹⁾	Yew Chung International School / PLK Choi Kai Yau School	Rooftop
AM3	Slope no. 07SW-D/FR4 near Garden Villa	On Ground
AM4	Government Quarters	Ground Floor ⁽²⁾

Note: ⁽¹⁾ Yew Chung International School / PLK Choi Kai Yau School had ceased operated and been demolished since February 2007. The air monitoring at AM1 has been suspended since February 2007, as approved by EPD on 26th April 2007.

⁽²⁾ The HVS was installed on the ground floor, which is close to the refuse collection station of the Government Quarters.

Monitoring Equipment

- 2.3 **Table 2.2** summarizes the equipment used in the impact air monitoring programme. Copies of calibration certificates are attached in **Appendix B**.

Table 2.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Quantity
Calibrator	GMW25; S/N: 1536	1
HVS Sampler	Graseby GMW Model GS2310 High Volume TSP Sampler and associated equipment and shelter	3

Monitoring Parameters, Frequency and Duration

- 2.4 **Table 2.3** summarizes the monitoring parameters and frequencies of impact dust monitoring for the whole construction period. The air quality monitoring schedule for the reporting period is shown in **Appendix C**.

Table 2.3 Impact Dust Monitoring Parameters, Frequency and Duration

Parameters	Frequency
1-hr TSP	Three times / 6 days
24-hr TSP	Once / 6 days

Monitoring Methodology and QA/QC Procedure

Instrumentation

- 2.5 Graseby GMW Model GS2310 TSP High Volume Sampler (HVS) was employed for 1-hour & 24-hour TSP monitoring. The sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complied with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50). Moreover, the HVS also met all the requirements in Sections 2.2 – 2.4 of the Updated EM&A Manual (1999).

Operating/Analytical Procedures

- 2.6 Operating/analytical procedures for the operation of HVS were as follows:
- A horizontal platform was provided with appropriate support to secure the samplers against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.
 - The sampler was more than 20 meters from the drip line.
 - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.
- 2.7 Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 1.1 m³/min. and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. For TSP sampling, fiberglass filters (G810) were used.
- 2.8 The power supply was checked to ensure the sampler worked properly. On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air monitoring station.
- 2.9 The filter holding frame was then removed by loosening the four nuts and a weighted and conditioned filter was carefully centered with the stamped number upwards, on a supporting screen.

- 2.10 The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- 2.11 The shelter lid was closed and secured with the aluminum strip. The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number). After sampling, the filter was removed and sent to the laboratory for weighing. The elapsed time was also recorded.
- 2.12 Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment temperature should be between 25°C and 30°C and not vary by more than $\pm 3^\circ\text{C}$; the relative humidity (RH) should be $< 50\%$ and not vary by more than $\pm 5\%$. A convenient working RH is 40%.

Maintenance/Calibration

- 2.13 The following maintenance/calibration was required for the HVS:
- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
 - High volume samplers were calibrated at bi-monthly intervals using GMW-25 Calibration Kit throughout all stages of the air quality monitoring.

Results and Observations

- 2.14 All TSP monitoring was conducted as scheduled in the reporting month.
- 2.15 No Action/Limit Level exceedance for both 1-hour TSP and 24-hour TSP was recorded in the reporting month.
- 2.16 Wind data monitoring equipment has been installed in Shatin Heights for logging wind speed and wind direction. These wind data are summarized in Appendix D.
- 2.17 The monitoring data and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in Appendices E and F, respectively.

3. NOISE

Monitoring Requirements

- 3.1 Monitoring and audit of construction noise levels is required to be conducted, in accordance with the EM&A Manual, to ensure that any unacceptable noise impacts could be readily detected and timely appropriate action be undertaken to rectify the situation.
- 3.2 The construction noise levels shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). L_{eq} (30min) shall be used as the monitoring parameter for the time period between 0700-1900 hours on normal weekdays. For all other time periods, L_{eq} (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. As supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 3.3 Three designated noise monitoring stations, namely NM1, NM5 & NM6 were selected for impact monitoring in accordance to the EM&A manual (1999) and the subsequent EPD approval of the relocations.
- 3.4 Noise monitoring is also required to be conducted at station NM7 in accordance with the EM&A Manual (1998). The noise monitoring at the station is required to be conducted under CEDD's construction Contract No. ST 89/02 "Sha Tin Heights Tunnel and Approaches" in accordance with the requirement of Environmental Permit No. EP104/2001/A. The impact noise monitoring results at station NM7 are also presented in this report.
- 3.5 **Appendix A** shows the established Action and Limit Levels for the environmental monitoring works.

Monitoring Locations

- 3.6 Noise monitoring was conducted at three designated monitoring stations as summarized in Table 3.1. Figures 1a & 1b show the locations of these stations.

Table 3.1 Noise Monitoring Stations

Monitoring Station	Description	Location
NM1 ⁽¹⁾	Yew Chung International School / PKL Choi Kai Yau School	Rooftop
NM5	Villa Carlton	Ground Floor ⁽²⁾
NM6	Government Quarters	Rooftop of Refuse Collection Station
NM7	Garden Villa	Rooftop

Note: ⁽¹⁾ Yew Chung International School / PLK Choi Kai Yau School had ceased operated and been demolished since February 2007. The noise monitoring at NM1 has been suspended since February 2007, as approved by EPD on 26th April 2007.

⁽²⁾ The noise measurement was taken at 2.3m above the ground floor of Villa Carlton, where has a line of sight of the construction site in the opposite.

Monitoring Equipment

- 3.7 Table 3.2 summarizes the noise monitoring equipment model being used. Copies of calibration certificates are attached in **Appendix B**.

Table 3.2 Noise Monitoring Equipment

Equipment	Model and Make	Qty.
Integrating Sound Level Meter	B&K Model 2238	5
Calibrator	B&K 4231	2
Wind Speed Anemometer	RS232 Integral Vane Digital Anemometer	1

Monitoring Parameters, Frequency and Duration

- 3.8 Table 3.3 summarizes the monitoring parameters, frequency and total duration of monitoring. The noise monitoring schedule is shown in **Appendix C**.

Table 3.3 Noise Monitoring Parameters, Frequency and Duration

Station	Parameter	Period ¹	Frequency	Measurement
NM1	L ₁₀ (30 min.)dB(A) L ₉₀ (30 min.)dB(A) L _{eq} (30 min.)dB(A)	(a) 0700-1900 hrs. on weekdays (b) 1900-2300 hrs. on weekdays (c) 0700-2300 hrs. on holidays (d) 2300-0700 hrs on any days	Once per week	Façade
NM5				Façade
NM6				Free Field
NM7				Façade

Note: ¹(b), (c) and (d) will only be conducted if construction works are undertaken during these periods.

Monitoring Methodology and QA/QC Procedures

- The Sound Level Meter was generally set on a tripod at a height of 1.2 m above the ground, depending to the actual monitoring condition.
- For free field measurement (if any), the meter was positioned away from any nearby reflective surfaces. All records for free field noise levels were adjusted with a correction of +3 dB(A).
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting : A
 - time weighting : Fast
 - time measurement : 30 minutes / 5 minutes
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1.0 dB, the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with the portable wind meter.
- At the end of the monitoring period, the L_{eq}, L₉₀ and L₁₀ were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.

- Noise measurement was paused during periods of high intrusive noise if possible and observation was recorded when intrusive noise was not avoided.
- Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.

Maintenance and Calibration

- 3.9 The microphone head of the sound level meter and calibrator was cleaned with soft cloth regularly. The meters were sent to the supplier to check and calibrate on a yearly interval.

Results and Observations

- 3.10 Noise monitoring was performed at the three designated locations as scheduled for the daytime period (0700-1900 hours) in this reporting month. Restricted-hour monitoring was also conducted at NM5, NM6 and NM7.
- 3.11 All the Construction Noise Levels (CNLs), except the monitoring (0700-1900 on weekdays) at NM6, reported in this report were adjusted with the corresponding baseline level (i.e. Measured Leq – Baseline Leq = Measured CNL), in order to facilitate the interpretation of the noise exceedance.
- 3.12 Noise monitoring results and graphical presentations are shown in **Appendix G**.
- 3.13 No Action/Limit Level exceedance for noise monitoring was recorded in the reporting month.

4. ENVIRONMENTAL AUDIT

Site Audits

- 4.1 Site audits were carried out on a weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Project site. The summaries of site audits are provided in **Appendix I**.
- 4.2 Site audits for Civil contract were conducted on 4th, 13th, 30th and 27th February 2008 by ET. A joint site audit for Civil works was conducted on 13th February 2008 with representatives from IEC, ER, Contractor and ET while the joint site audit for TCSS works was also conducted on 13th February 2008 with the representatives from IEC, ER, Contractor and ET. No environmental deficiency was recorded for TCSS contract during site inspections.

Review of Environmental Monitoring Procedures

- 4.3 The monitoring works conducted by the monitoring team were inspected regularly. The following observations have been recorded for the monitoring works:

Air Quality Monitoring

- The monitoring team recorded all observations around the monitoring stations within and outside the construction site.
- The monitoring team recorded the temperature and weather conditions on the monitoring days.

Noise Monitoring

- The monitoring team recorded all observations around the monitoring stations, which might affect the monitoring result.
- Major noise sources were identified and recorded. Other intrusive noise attributing to the result was trimmed off by pausing the monitoring temporarily.

Status of Environmental Licensing and Permitting

- 4.4 All valid permits/licenses obtained for the Project are summarized in **Table 4.1**. No new CNP was issued to the Project by EPD in the reporting month.

Implementation Status of Environmental Mitigation Measures

- 4.5 According to the Environmental Permit and the EM&A Manuals, the mitigation measures detailed in the documents are required to be implemented. An updated summary of the EMIS is provided in **Appendix K**.

Table 4.1 Summary of Environmental Licensing and Permit Status

Permit No.	Valid Period		Details	Status
	From	To		
Environmental Permit (EP)				
EP-103/2001/C	22/07/05	N/A	Construction and operation of (a) All civil works (including highways, traffic, geotechnical, drainage, structural, architectural and landscaping works) for the Lai Chi Kok Viaduct, the interchange with Ching Cheung Road, the main road within Butterfly Valley and the Eagle's Nest Tunnel; (b) All E&M works (including ventilation, Traffic Control & Surveillance System (TCSS), toll collection system and lighting) for the whole Route 9 between Cheung Sha Wan and Sha Tin; (c) The permanent slope works above the northern portal of the Eagle's Nest Tunnel; (d) The architectural works (including fitting out and furnishings) of the portal buildings of the Sha Tin Heights Tunnel.	Valid
Registration of Chemical Waste Producer				
WPN 5213-761-L2595-01	26/01/04	N/A	Regulation for disposal of spent oil and waste batteries arising from construction activities in all project areas.	Valid
Water Discharge Licence				
EP482/261/0327/I	03/05/04	31/05/09	Discharge of industrial trade effluent and effluent arising from construction activities at the construction site at Ventilation Adit on Tai Po Road (behind Shell Filling Station) opposite Pinehill Development Highways.	Valid
EP482/261/0326/I	01/04/04	30/04/09	Discharge of industrial trade effluent and effluent arising from construction activities at the construction site at Mui Kong Tsuen, Butterfly Valley, Lai Chi Kok, Kowloon.	Valid
No. 3156	23/02/04	22/02/09	Discharge of industrial trade effluent and all other wastewater arising from the works areas at North Portal of Route 9 – Eagle's Nest Tunnel and Associated Works (Contract HY/2003/02).	Valid
Construction Noise Permit (CNP)				
GW-RN0514-07	30/11/07	29/05/08	<i>Location:</i> SHT-North Portal near Tai Po Road and Keng Hau Road <i>Time Period:</i> 0700-2300 (general holiday including Sundays) and 1900-2300 (any day not being a general holiday).	Valid
GW-RN0515-07	30/11/07	29/05/08	<i>Location:</i> Tunnel North Portal Site near Garden Villa <i>Time Period:</i> 0700-2300 (general holiday including Sundays) and 1900-2300 (any day not being a general holiday).	Valid
GW-RN0513-07	30/11/07	29/05/08	<i>Location:</i> Tunnel South Portal Site at Butterfly Valley <i>Time Period:</i> 0700-2300 (general holiday including Sundays) and 1900-2300 (any day not being a general holiday).	Valid

- 4.6 Spot checks on truck overloading were also conducted during the site inspections since June 2006. No overloading incident was observed during the site inspections in the reporting month.
- 4.7 No non-conformance was identified during the site inspections in the reporting month. The observations and recommendations are summarized in **Table 4.2**.

Table 4.2 Observations and Recommendations of Site Audit for Civil Works

Parameters	Date	Observations / Recommendations	Remedial Actions / Remarks
Air Quality	20/02/08	Uncovered stockpile was observed near ENT South Portal Building. The Contractor was advised to cover it with tarpaulin.	It has been rectified on 27/02/08

- 4.8 The observations and recommendations arising from pervious month and followed up in the reporting month are summarized in **Table 4.3**.

Table 4.3 Observations and Recommendations of Site Audits Followed up for Pervious Month for Civil Works

Parameters	Date	Observations / Recommendations	Remedial Actions
NIL	---	---	---

Summary of Exceedances

1-hr and 24-hr TSP Monitoring

- 4.9 No Action/Limit Level exceedance for both 1-hour TSP and 24-hour TSP was recorded in the reporting month.

Construction noise

- 4.10 No Action/Limit Level exceedance for noise monitoring was recorded in the reporting month.

Implementation Status of Event Action Plans

- 4.11 The Event Action Plans for air quality and noise are presented in **Appendix J**.

Summary of Complaints and Prosecutions

- 4.12 No environmental related complaint or prosecution was received in the reporting month.
- 4.13 There were 22 environmental complaints and no prosecution received since the commencement of the Project. The updated Complaint Log is shown in **Appendix M**.

5. FUTURE KEY ISSUES

Key Issues for the Coming Month

5.1 Key issues to be considered in the coming months include:

- General refuse generated from fencing, cladding and handrail installation works; and noise nuisance from erection of 7m Noise Barrier.

Monitoring Schedule for the Next Month

5.2 The tentative environmental monitoring schedule for next month is shown in **Appendix C**.

Construction Program for the Next Month

5.3 The tentative construction program for civil works is provided in **Appendix L**. The major construction activities for civil works in the coming months include:

Butterfly Valley

- Boundary fencing, re-created stream (DSD access Rd), 7m Noise Barrier (Mesh Panel) and irrigation pipe & system (T&C).

South Portal Building

- Metal meshing cladding, plumbing & drainage (T&C), tunnel ventilation system (T&C) and the mechanical ventilation air conditioning (T&C).

North Portal Building

- Metal meshing cladding, plumbing & drainage (T&C), tunnel ventilation system (T&C) and the mechanical ventilation air conditioning (T&C).

Toll Plaza's Structures and Administration Building

- Roof tiles, fire services (T&C), mechanical ventilation air conditioning (T&C) and plumbing & drainage (T&C).

Ventilation Building

- Hand rail installation, slope fencing, metal mesh cladding, plumbing & drainage (T&C), mechanical ventilation air conditioning (T&C) and Tunnel Ventilation System (T&C).

SHT – South Portal Building

- Mesh cladding, plumbing & drainage (T&C), mechanical ventilation air conditioning (T&C) and tunnel ventilation system (T&C).

SHT – North Portal Building

- Mesh cladding, plumbing & drainage (T&C), mechanical ventilation air conditioning (T&C) and tunnel ventilation system (T&C).

SHT Tunnel & Remaining SHT/T3 Area

- Tunnel ventilation system (T&C) and fire services (T&C).

5.4 The tentative construction program for TCSS works is provided in **Appendix L**. The major site activities for TCSS works in the coming months include:

- Site Acceptance Tests (SAT) for TCSS equipment.

6. CONCLUSIONS AND RECOMMENDATIONS

Conclusions

- 6.1 Environmental monitoring works were performed in the reporting month and all monitoring results were checked and reviewed.
- 6.2 No Action/Limit Level exceedance for 1-hour TSP and 24-hours TSP was recorded in the reporting month.
- 6.3 No Action/Limit Level exceedance for noise monitoring was recorded in the reporting month.
- 6.4 No environmental complaint or prosecution was received in the reporting month.

Recommendations

- 6.5 According to the environmental audit performed in the reporting month, the following recommendations were made:

Water Impact

- To closely monitor the capacity of existing de-silting facility on site, especially for the discharge at the site in Butterfly Valley.
- To keep the sedimentation facilities well maintained and perform de-silting regularly.
- To avoid accumulation of stagnant water on site.

Dust Impact

- To ensure that adequate water spray or other dust suppression measures are applied for slope cutting and the haul roads and stockpile on site.
- To cover idle soil slope surface and stockpile of dusty materials to prevent wind erosion.
- To ensure that all vehicles carrying dusty materials are properly covered before leaving the site.


Noise Impact

- To provide temporary noise barriers for noisy activities (such as breaking works).
- To reduce the number of noisy equipment in concurrent operation.

Waste/Chemical Management

- To ensure proper storage of chemical and chemical waste on site.
- To check for any accumulation of waste materials or rubbish on site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly.

FIGURES

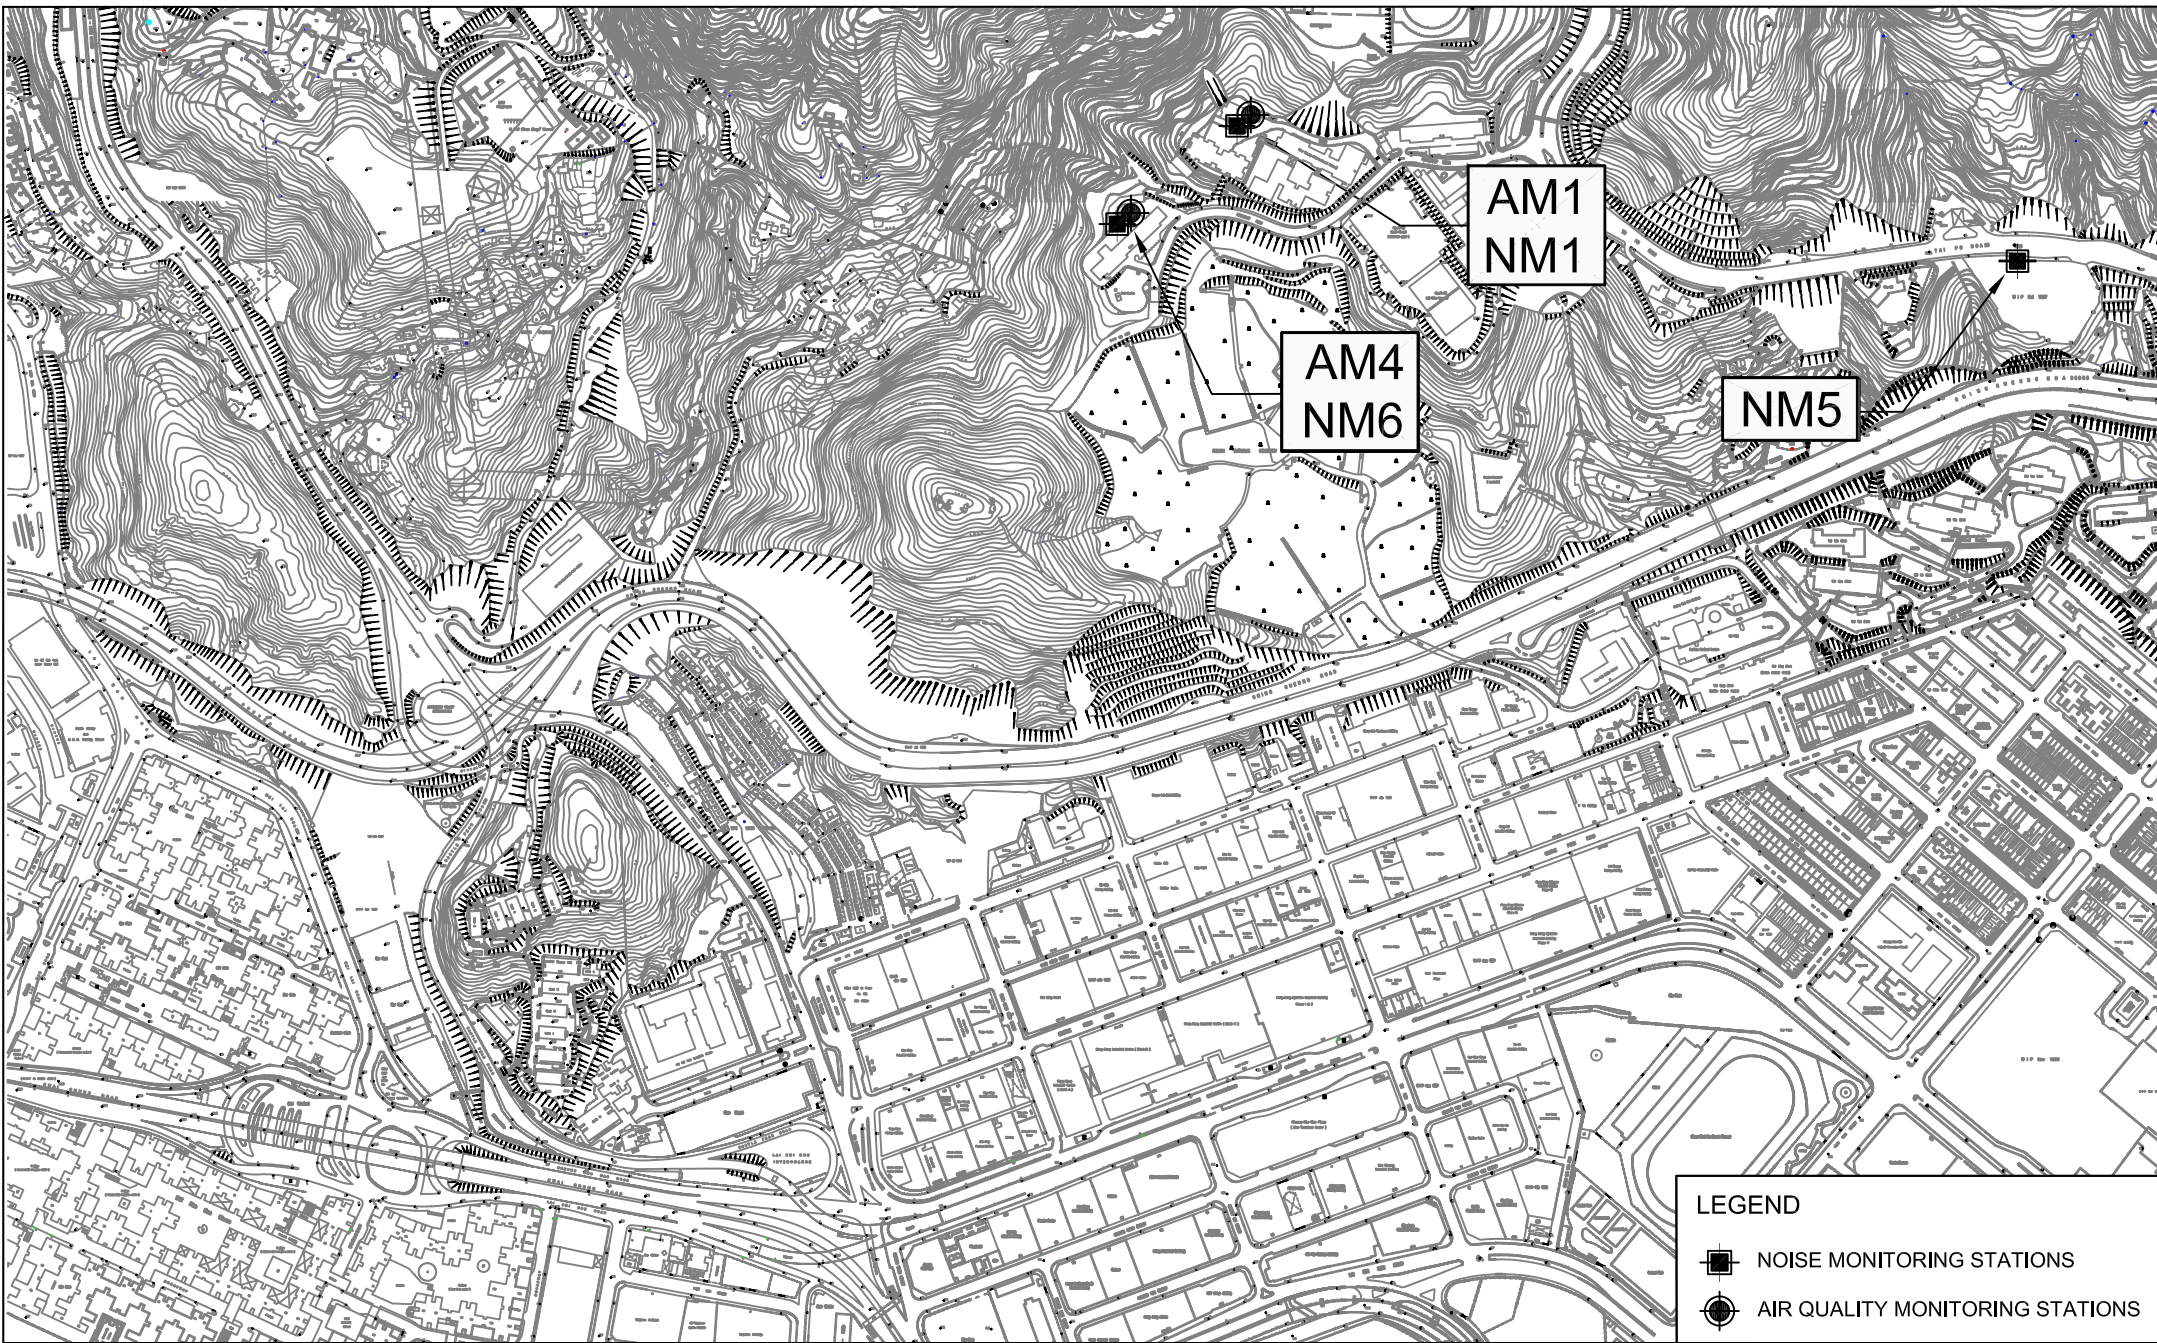

LEGEND	
	NOISE MONITORING STATIONS
	AIR QUALITY MONITORING STATIONS

Title

ROUTE 8 (PREVIOUSLY KNOWN AS ROUTE 9) BETWEEN CHEUNG SHA WAN AND SHA TIN
 CONTRACT NO. HY/2003/02 - EAGLE'S NEST TUNNEL AND ASSOCIATED WORKS

LOCATIONS OF MONITORING STATIONS


Scale
1 : 6500 (A4)

Date
2006

Project No.
MA3024

Figure No.
1a



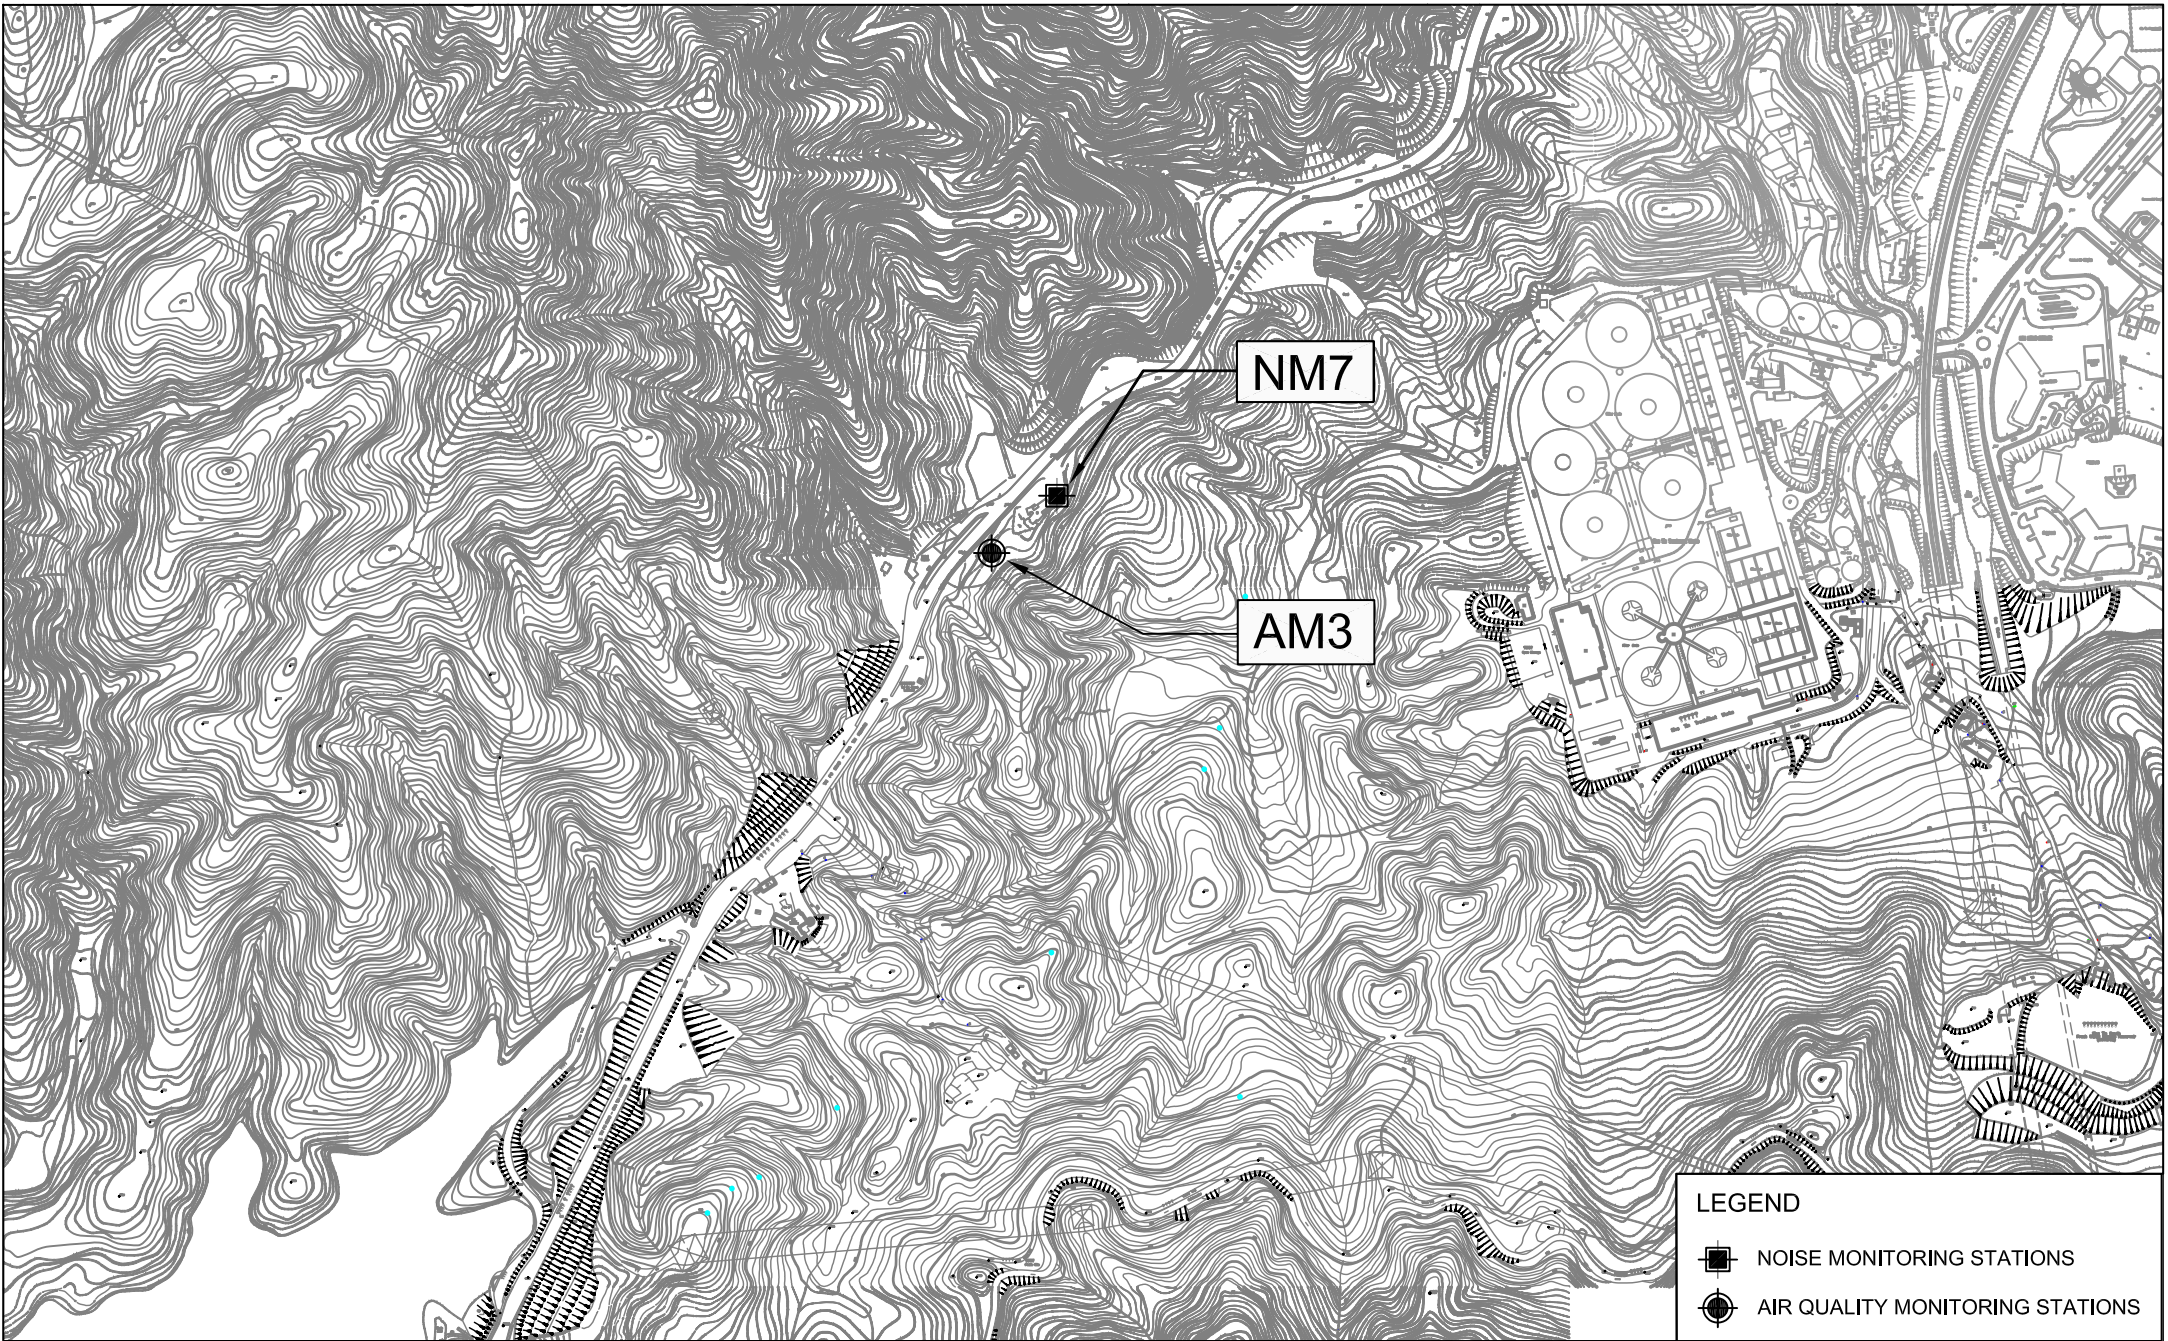

LEGEND	
	NOISE MONITORING STATIONS
	AIR QUALITY MONITORING STATIONS

Title

ROUTE 8 (PREVIOUSLY KNOWN AS ROUTE 9) BETWEEN CHEUNG SHA WAN AND SHA TIN
 CONTRACT NO. HY/2003/02 - EAGLE'S NEST TUNNEL AND ASSOCIATED WORKS

LOCATIONS OF MONITORING STATIONS

Scale
1 : 6500 (A4)

Date
2006

Project No.
MA3024

Figure No.
1b



**APPENDIX A
ACTION AND LIMIT LEVELS**

Appendix A - Action and Limit Levels (ENT)

1-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AM1	296	500
AM3	350	
AM4	294	

24-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AM1	168	260
AM3	200	
AM4	170	

Construction Noise

Period	Action Level	Limit Level, dB(A)			
	for all stations	NM1	NM5	NM6	NM7
0700-1900 hrs on normal weekdays	When one documented complaint is received	70/65*	75	75	75
0700-2300 hrs on holidays & 1900-2300 hrs on all other days		-	70	65	60
2300-0700 hrs of next day		-	55	50	45

- (*) Since NM1 is an educational institution, the noise Limit Level (0700-1900 hrs on normal days) is taken as 70 dB(A). The Limit Level will be reduced to 65 dB(A) during school examination periods.

**APPENDIX B
COPIES OF CALIBRATION
CERTIFICATES**

WELLAB LTD.

Unit C, 1/F, Goldlion Holdings Center
13-15 Yuen Shun Circuit,
Shatin, Hong Kong.
Tel: (852) 2898 7388
Fax: (852) 2898 7076

TEST REPORT

APPLICANT: Cinotech Consultants Limited
1602-1610 Delta House,
3 On Yiu Street,
Shatin, N.T.

Test Report No.:	C/07/70502
Date of Issue:	2007-05-02
Date Received:	2007-05-01
Date Tested:	2007-05-01
Date Completed:	2007-05-02

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description : RS232 Integral Vane Digital Anemometer
Manufacturer : AZ Instrument
Model No. : 451104
Serial No. : 9020746
Equipment No. : A-03-01

Test conditions:

Room Temperature : 21 degree Celsius
Relative Humidity : 65%
Pressure : 101.3 kPa

Methodology:


The anemometer has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

	Reference Set Point	Instrument Readings
Measuring Air Velocity, m/s	2.00	2.00
Temperature, °C	21.0	21.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE

Senior Chemist



TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE.
 VILLAGE OF CLEVELAND, OH 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX
 WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Mar 12, 2007 Rootmeter S/N 9833640 Ta (K) - 294
 Operator Tisch Orifice I.D. - 0999 Pa (mm) - 746.76

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.3890	3.2	2.00
2	NA	NA	1.00	0.9850	6.3	4.00
3	NA	NA	1.00	0.8810	7.8	5.00
4	NA	NA	1.00	0.8410	8.6	5.50
5	NA	NA	1.00	0.6950	12.5	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
0.9917	0.7139	1.4113	0.9957	0.7168	0.8874
0.9876	1.0026	1.9959	0.9916	1.0067	1.2549
0.9854	1.1185	2.2315	0.9894	1.1231	1.4030
0.9844	1.1706	2.3405	0.9884	1.1753	1.4715
0.9792	1.4090	2.8227	0.9832	1.4147	1.7747
Qstd slope (m) = 2.03154			Qa slope (m) = 1.27212		
intercept (b) = -0.03970			intercept (b) = -0.02496		
coefficient (r) = 0.99999			coefficient (r) = 0.99999		
y axis = SQRT[H2O(Pa/760)(298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
 Qa = Va/Time


For subsequent flow rate calculations:

Qstd = 1/m{[SQRT(H2O(Pa/760)(298/Ta))] - b}
 Qa = 1/m{[SQRT H2O(Ta/Pa)] - b}



TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE.
 VILLAGE OF CLEVELAND, OH 45002
 513.467.9000
 877.253.7610 TOLL FREE
 513.467.9009 FAX
 WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

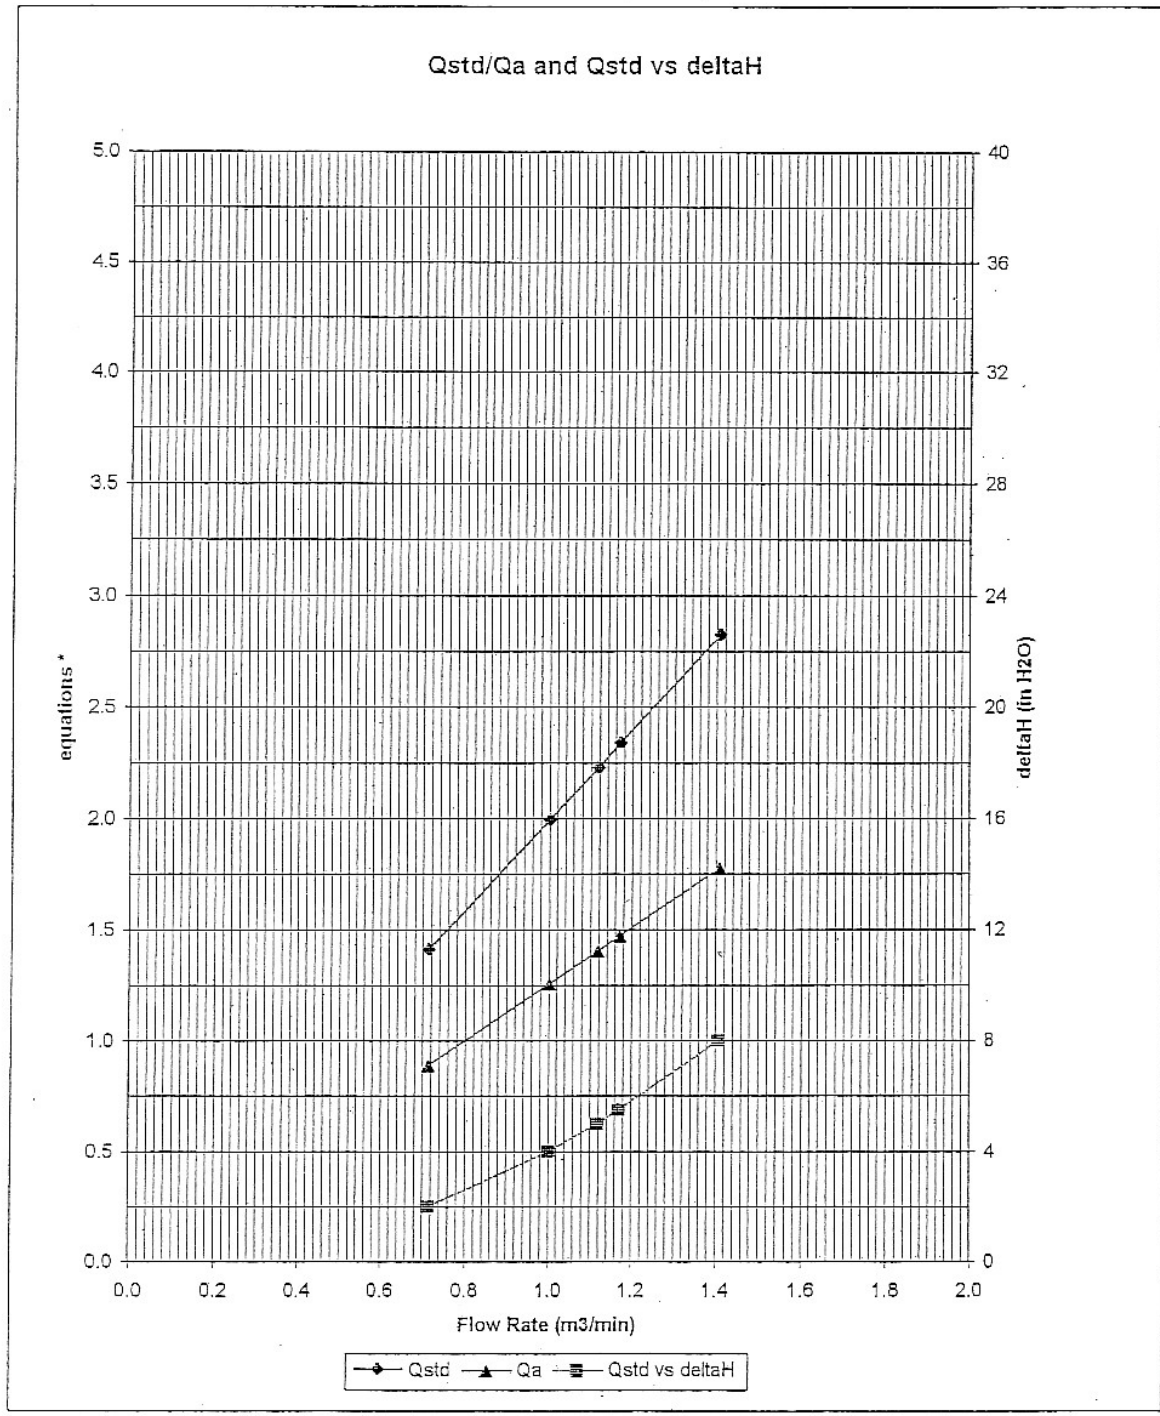

* y-axis equations:

Qstd series:
$$\sqrt{\Delta H \left(\frac{P_a}{P_{std}} \right) \left(\frac{T_{std}}{T_a} \right)}$$

Qa series:
$$\sqrt{(\Delta H (T_a / P_a))}$$

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/N/71213/1
Date of Issue:	2007-12-14
Date Received:	2007-12-13
Date Tested:	2007-12-14
Date Completed:	2007-12-14
Next Due Date:	2008-12-13

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description	: Integrating Sound Level Meter
Manufacturer	: Brüel & Kjær
Model No.	: B&K 2238
Serial No.	: 2337665
Microphone No.	: 2289749
Equipment No.	: N-01-01

Test conditions:

Room Temperature	: 20 degree Celsius
Relative Humidity	: 60%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Senior Chemist

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/N/71116/1
Date of Issue:	2007-11-16
Date Received:	2007-11-15
Date Tested:	2007-11-15
Date Completed:	2007-11-16
Next Due Date:	2008-11-15

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description	: Integrating Sound Level Meter
Manufacturer	: Brüel & Kjær
Model No.	: B&K 2238
Serial No.	: 2337666
Microphone No.	: 2289750
Equipment No.	: N-01-02

Test conditions:

Room Temperature	: 20 degree Celsius
Relative Humidity	: 59%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Senior Chemist

TEST REPORT

APPLICANT: Cinotech Consultants Limited
1601-1610 Delta House,
3 On Yiu Street,
Shatin, N.T.

Test Report No.:	C/N/70903-1
Date of Issue:	2007-09-03
Date Received:	2007-09-01
Date Tested:	2007-09-03
Date Completed:	2007-09-03
Next Due Date:	2008-09-02

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description	: Integrating Sound Level Meter
Manufacturer	: Brüel & Kjær
Model No.	: B&K 2238
Serial No.	: 2359311
Microphone No.	: 2346382
Equipment No.	: N-01-03

Test conditions:

Room Temperature	: 22 degree Celsius
Relative Humidity	: 62%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Senior Chemist

TEST REPORT

APPLICANT: Cinotech Consultants Limited
1602-1610 Delta House,
3 On Yiu Street,
Shatin, N.T.

Test Report No.:	C/N/70903-2
Date of Issue:	2007-09-03
Date Received:	2007-09-01
Date Tested:	2007-09-03
Date Completed:	2007-09-03
Next Due Date:	2008-09-02

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description	: Integrating Sound Level Meter
Manufacturer	: Brüel & Kjær
Model No.	: B&K 2238
Serial No.	: 2359303
Equipment No.	: N-01-04

Test conditions:

Room Temperature	: 22 degree Celsius
Relative Humidity	: 62%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Senior Chemist

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/N/71015/1
Date of Issue:	2007-10-15
Date Received:	2007-10-13
Date Tested:	2007-10-13
Date Completed:	2007-10-15
Next Due Date:	2008-10-14

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description	: Integrating Sound Level Meter
Manufacturer	: Brüel & Kjær
Model No.	: B&K 2238
Serial No.	: 2394976
Microphone No.	: 2407349
Equipment No.	: N-01-05

Test conditions:

Room Temperature	: 21 degree Celsius
Relative Humidity	: 60%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Senior Chemist

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/N/71116/2
Date of Issue:	2007-11-16
Date Received:	2007-11-15
Date Tested:	2007-11-15
Date Completed:	2007-11-16
Next Due Date:	2008-11-15

ATTN: Mr. Henry Leung

Page: 1 of 1

Item for calibration:

Description	: Acoustical Calibrator
Manufacturer	: Brüel & Kjær
Model No.	: 4231
Serial No.	: 2326353
Project No.	: C13
Equipment No.	: N-02-01

Test conditions:

Room Temperature	: 20 degree Celsius
Relative Humidity	: 59%
Pressure	: 1015.2 hPa

Methodology:

The sound calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Senior Chemist

WELLAB LTD.

Unit C, 1/F, Goldlion Holdings Center
13-15 Yuen Shun Circuit,
Shatin, Hong Kong.
Tel: (852) 2898 7388
Fax: (852) 2898 7076

TEST REPORT

APPLICANT: Cinotech Consultants Limited
1602-1610 Delta House,
3 On Yiu Street,
Shatin, N.T.

Test Report No.:	C/06/70305
Date of Issue:	2007-03-05
Date Received:	2007-03-03
Date Tested:	2007-03-03
Date Completed:	2007-03-05
Next Due Date:	2008-03-04

ATTN: Mr. Henry Leung

Page: 1 of 1

Item for calibration:

Description	: Acoustical Calibrator
Manufacturer	: Brüel & Kjær
Model No.	: 4231
Serial No.	: 2343007
Project No.	: C13
Equipment No.	: N-02-02

Test conditions:

Room Temperature	: 20 degree Celsius
Relative Humidity	: 65%
Pressure	: 1020.1hPa

Methodology:

The sound calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.2 dB

PREPARED AND CHECKED BY:
For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Operation Manager

TEST REPORT

APPLICANT: Cinotech Consultants Limited
1602-1610 Delta House,
3 On Yiu Street,
Shatin, N.T.

Test Report No.:	C/N/70903-3
Date of Issue:	2007-09-03
Date Received:	2007-09-01
Date Tested:	2007-09-03
Date Completed:	2007-09-03
Next Due Date:	2008-09-02

ATTN: Mr. Henry Leung

Page: 1 of 1

Item for calibration:

Description	: Acoustical Calibrator
Manufacturer	: Brüel & Kjær
Model No.	: 4231
Serial No.	: 2412367
Equipment No.	: N-02-03

Test conditions:

Room Temperature	: 22 degree Celsius
Relative Humidity	: 62%

Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**


PATRICK TSE
Senior Chemist

**APPENDIX C
ENVIRONMENTAL MONITORING AND
AUDIT SCHEDULE**

**Environmental Monitoring for Eagle's Nest Tunnel
Tentative Air Quality and Noise Monitoring Schedule for February 2008**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
27-Jan	28-Jan	29-Jan	30-Jan	31-Jan	1-Feb	2-Feb
		1 hr TSP 24 hr TSP	1 hr TSP	1 hr TSP Noise		
3-Feb	4-Feb	5-Feb	6-Feb	7-Feb	8-Feb	9-Feb
	1 hr TSP 24 hr TSP	1 hr TSP	1 hr TSP Noise			
10-Feb	11-Feb	12-Feb	13-Feb	14-Feb	15-Feb	16-Feb
		1 hr TSP 24 hr TSP	1 hr TSP	1 hr TSP Noise		
17-Feb	18-Feb	19-Feb	20-Feb	21-Feb	22-Feb	23-Feb
	24 hr TSP	1 hr TSP	1 hr TSP Noise	1 hr TSP		24 hr TSP
24-Feb	25-Feb	26-Feb	27-Feb	28-Feb	29-Feb	1-Mar
	1 hr TSP	1 hr TSP		1 hr TSP Noise	24 hr TSP	

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

AM3 Garden Villa
AM4 Government Quarters

NM5 Villa Carlton
NM6 Government Quarters
NM7 Garden Villa

**Environmental Monitoring for Eagle's Nest Tunnel
Tentative Air Quality and Noise Monitoring Schedule for March 2008**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
2-Mar	3-Mar	4-Mar	5-Mar	6-Mar	7-Mar	8-Mar
		1 hr TSP		1 hr TSP Noise 24 hr TSP	1 hr TSP	
9-Mar	10-Mar	11-Mar	12-Mar	13-Mar	14-Mar	15-Mar
		1 hr TSP	1 hr TSP Noise 24 hr TSP	1 hr TSP		
16-Mar	17-Mar	18-Mar	19-Mar	20-Mar	21-Mar	22-Mar
	1 hr TSP Noise	1 hr TSP 24 hr TSP	1 hr TSP			
23-Mar	24-Mar	25-Mar	26-Mar	27-Mar	28-Mar	29-Mar
	24 hr TSP	1 hr TSP		1 hr TSP	1 hr TSP Noise	24 hr TSP
30-Mar	31-Mar	1-Apr	2-Apr	3-Apr	4-Apr	5-Apr
	1 hr TSP					

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

AM3 Garden Villa
AM4 Government Quarters

NM5 Villa Carlton
NM6 Government Quarters
NM7 Garden Villa

APPENDIX D
WIND DATA

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
1-Feb-2008	00:00	1.6	WSW
1-Feb-2008	01:00	1.6	W
1-Feb-2008	02:00	2.1	WSW
1-Feb-2008	03:00	2.4	WSW
1-Feb-2008	04:00	2.5	WSW
1-Feb-2008	05:00	2.1	W
1-Feb-2008	06:00	2.6	W
1-Feb-2008	07:00	2.4	SW
1-Feb-2008	08:00	1.5	SSW
1-Feb-2008	09:00	1.9	W
1-Feb-2008	10:00	1.8	W
1-Feb-2008	11:00	2.1	W
1-Feb-2008	12:00	1.6	W
1-Feb-2008	13:00	1.9	W
1-Feb-2008	14:00	1.9	WNW
1-Feb-2008	15:00	1.8	WNW
1-Feb-2008	16:00	1.2	WNW
1-Feb-2008	17:00	1.3	WNW
1-Feb-2008	18:00	1.9	WSW
1-Feb-2008	19:00	1.2	WNW
1-Feb-2008	20:00	1.5	WSW
1-Feb-2008	21:00	1.2	W
1-Feb-2008	22:00	2.1	WNW
1-Feb-2008	23:00	2.5	W
2-Feb-2008	00:00	2.6	WNW
2-Feb-2008	01:00	2.8	WNW
2-Feb-2008	02:00	3.2	WNW
2-Feb-2008	03:00	2.9	WSW
2-Feb-2008	04:00	2.8	SW
2-Feb-2008	05:00	2.8	SW
2-Feb-2008	06:00	3.1	SW
2-Feb-2008	07:00	2.5	SW
2-Feb-2008	08:00	3.0	SW
2-Feb-2008	09:00	3.1	SW
2-Feb-2008	10:00	3.5	SW
2-Feb-2008	11:00	4.1	SW
2-Feb-2008	12:00	4.1	WSW
2-Feb-2008	13:00	4.6	SW
2-Feb-2008	14:00	3.7	S
2-Feb-2008	15:00	4.1	WSW
2-Feb-2008	16:00	3.7	W
2-Feb-2008	17:00	3.5	W
2-Feb-2008	18:00	3.1	WSW
2-Feb-2008	19:00	3.4	W
2-Feb-2008	20:00	3.1	W
2-Feb-2008	21:00	2.8	W
2-Feb-2008	22:00	0.9	WNW
2-Feb-2008	23:00	0.9	NNE
3-Feb-2008	00:00	0.9	WNW
3-Feb-2008	01:00	0.0	---
3-Feb-2008	02:00	0.0	---
3-Feb-2008	03:00	1.6	WNW
3-Feb-2008	04:00	1.9	W
3-Feb-2008	05:00	1.9	WSW

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
3-Feb-2008	06:00	2.1	WSW
3-Feb-2008	07:00	1.5	WSW
3-Feb-2008	08:00	1.6	WSW
3-Feb-2008	09:00	2.2	W
3-Feb-2008	10:00	3.4	WSW
3-Feb-2008	11:00	2.6	W
3-Feb-2008	12:00	2.5	WSW
3-Feb-2008	13:00	2.1	WNW
3-Feb-2008	14:00	2.5	NW
3-Feb-2008	15:00	2.4	WNW
3-Feb-2008	16:00	2.2	WNW
3-Feb-2008	17:00	2.1	W
3-Feb-2008	18:00	2.1	W
3-Feb-2008	19:00	2.1	WNW
3-Feb-2008	20:00	2.6	WNW
3-Feb-2008	21:00	2.4	WNW
3-Feb-2008	22:00	2.2	WNW
3-Feb-2008	23:00	2.2	WNW
4-Feb-2008	00:00	2.2	W
4-Feb-2008	01:00	2.4	W
4-Feb-2008	02:00	2.5	W
4-Feb-2008	03:00	1.6	WSW
4-Feb-2008	04:00	1.0	SW
4-Feb-2008	05:00	0.7	SW
4-Feb-2008	06:00	0.7	SSW
4-Feb-2008	07:00	1.2	SSW
4-Feb-2008	08:00	0.7	SSW
4-Feb-2008	09:00	1.2	SSW
4-Feb-2008	10:00	1.9	SW
4-Feb-2008	11:00	1.5	W
4-Feb-2008	12:00	1.3	W
4-Feb-2008	13:00	1.0	WSW
4-Feb-2008	14:00	1.0	W
4-Feb-2008	15:00	0.7	W
4-Feb-2008	16:00	2.0	WSW
4-Feb-2008	17:00	1.2	WSW
4-Feb-2008	18:00	1.8	W
4-Feb-2008	19:00	1.0	W
4-Feb-2008	20:00	1.2	WSW
4-Feb-2008	21:00	1.6	SW
4-Feb-2008	22:00	2.2	SW
4-Feb-2008	23:00	2.1	WSW
5-Feb-2008	00:00	2.1	W
5-Feb-2008	01:00	2.1	W
5-Feb-2008	02:00	2.5	W
5-Feb-2008	03:00	3.0	W
5-Feb-2008	04:00	2.5	SSW
5-Feb-2008	05:00	2.2	SSW
5-Feb-2008	06:00	2.2	W
5-Feb-2008	07:00	2.4	W
5-Feb-2008	08:00	1.6	NW
5-Feb-2008	09:00	1.9	WNW
5-Feb-2008	10:00	1.6	W
5-Feb-2008	11:00	1.5	WNW

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
5-Feb-2008	12:00	2.1	WSW
5-Feb-2008	13:00	1.6	SW
5-Feb-2008	14:00	1.9	W
5-Feb-2008	15:00	1.8	SW
5-Feb-2008	16:00	1.8	SW
5-Feb-2008	17:00	1.5	SW
5-Feb-2008	18:00	2.4	WNW
5-Feb-2008	19:00	0.7	WNW
5-Feb-2008	20:00	1.2	W
5-Feb-2008	21:00	1.2	SW
5-Feb-2008	22:00	0.6	W
5-Feb-2008	23:00	1.5	WNW
6-Feb-2008	00:00	1.5	WSW
6-Feb-2008	01:00	0.6	WNW
6-Feb-2008	02:00	0.5	WSW
6-Feb-2008	03:00	1.2	WNW
6-Feb-2008	04:00	0.9	W
6-Feb-2008	05:00	0.1	SW
6-Feb-2008	06:00	0.4	W
6-Feb-2008	07:00	0.0	---
6-Feb-2008	08:00	0.0	---
6-Feb-2008	09:00	0.9	WNW
6-Feb-2008	10:00	1.3	W
6-Feb-2008	11:00	2.2	WNW
6-Feb-2008	12:00	1.6	WNW
6-Feb-2008	13:00	2.2	WNW
6-Feb-2008	14:00	2.2	WNW
6-Feb-2008	15:00	2.1	W
6-Feb-2008	16:00	1.8	WNW
6-Feb-2008	17:00	1.6	WSW
6-Feb-2008	18:00	1.3	WSW
6-Feb-2008	19:00	1.6	WSW
6-Feb-2008	20:00	1.5	SW
6-Feb-2008	21:00	1.6	WNW
6-Feb-2008	22:00	1.8	W
6-Feb-2008	23:00	1.5	WNW
7-Feb-2008	00:00	1.8	WNW
7-Feb-2008	01:00	1.0	NNW
7-Feb-2008	02:00	0.9	WNW
7-Feb-2008	03:00	1.3	WNW
7-Feb-2008	04:00	1.2	WNW
7-Feb-2008	05:00	0.6	N
7-Feb-2008	06:00	0.6	NNE
7-Feb-2008	07:00	0.7	NNE
7-Feb-2008	08:00	0.9	NNE
7-Feb-2008	09:00	1.3	NE
7-Feb-2008	10:00	1.5	NE
7-Feb-2008	11:00	1.9	NE
7-Feb-2008	12:00	2.1	N
7-Feb-2008	13:00	1.6	W
7-Feb-2008	14:00	1.2	W
7-Feb-2008	15:00	1.9	W
7-Feb-2008	16:00	2.2	W
7-Feb-2008	17:00	2.4	WSW

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
7-Feb-2008	18:00	2.2	W
7-Feb-2008	19:00	2.1	SW
7-Feb-2008	20:00	2.4	W
7-Feb-2008	21:00	2.4	WSW
7-Feb-2008	22:00	2.4	WSW
7-Feb-2008	23:00	3.1	W
8-Feb-2008	00:00	1.8	WSW
8-Feb-2008	01:00	1.6	WNW
8-Feb-2008	02:00	1.2	SSW
8-Feb-2008	03:00	1.5	SSW
8-Feb-2008	04:00	1.8	WSW
8-Feb-2008	05:00	1.3	WSW
8-Feb-2008	06:00	1.8	WSW
8-Feb-2008	07:00	0.9	WSW
8-Feb-2008	08:00	0.7	WSW
8-Feb-2008	09:00	1.4	WNW
8-Feb-2008	10:00	2.2	W
8-Feb-2008	11:00	2.4	WSW
8-Feb-2008	12:00	2.5	WSW
8-Feb-2008	13:00	3.0	WSW
8-Feb-2008	14:00	3.5	WSW
8-Feb-2008	15:00	3.4	WSW
8-Feb-2008	16:00	3.7	WNW
8-Feb-2008	17:00	3.7	WSW
8-Feb-2008	18:00	3.9	WSW
8-Feb-2008	19:00	3.4	WSW
8-Feb-2008	20:00	2.1	WNW
8-Feb-2008	21:00	2.4	WNW
8-Feb-2008	22:00	2.8	WNW
8-Feb-2008	23:00	2.4	WNW
9-Feb-2008	00:00	3.1	WSW
9-Feb-2008	01:00	3.0	WNW
9-Feb-2008	02:00	2.8	WNW
9-Feb-2008	03:00	1.8	WNW
9-Feb-2008	04:00	2.4	WNW
9-Feb-2008	05:00	2.4	W
9-Feb-2008	06:00	1.4	W
9-Feb-2008	07:00	1.4	W
9-Feb-2008	08:00	2.2	W
9-Feb-2008	09:00	2.6	WNW
9-Feb-2008	10:00	2.9	WNW
9-Feb-2008	11:00	2.8	WNW
9-Feb-2008	12:00	2.8	NW
9-Feb-2008	13:00	2.8	WNW
9-Feb-2008	14:00	2.0	WNW
9-Feb-2008	15:00	2.9	WNW
9-Feb-2008	16:00	3.3	WNW
9-Feb-2008	17:00	2.8	W
9-Feb-2008	18:00	3.2	W
9-Feb-2008	19:00	3.1	W
9-Feb-2008	20:00	3.1	W
9-Feb-2008	21:00	2.8	WNW
9-Feb-2008	22:00	2.5	WNW
9-Feb-2008	23:00	1.9	W

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
10-Feb-2008	00:00	1.6	NE
10-Feb-2008	01:00	0.6	N
10-Feb-2008	02:00	0.6	NNE
10-Feb-2008	03:00	0.6	NE
10-Feb-2008	04:00	0.7	ESE
10-Feb-2008	05:00	0.9	ESE
10-Feb-2008	06:00	0.1	SSW
10-Feb-2008	07:00	0.0	---
10-Feb-2008	08:00	0.0	---
10-Feb-2008	09:00	0.6	WNW
10-Feb-2008	10:00	1.3	WNW
10-Feb-2008	11:00	1.7	WNW
10-Feb-2008	12:00	2.5	WNW
10-Feb-2008	13:00	2.6	N
10-Feb-2008	14:00	2.4	NNE
10-Feb-2008	15:00	2.5	NE
10-Feb-2008	16:00	2.4	NE
10-Feb-2008	17:00	3.2	NE
10-Feb-2008	18:00	2.9	NE
10-Feb-2008	19:00	3.0	E
10-Feb-2008	20:00	2.1	ENE
10-Feb-2008	21:00	2.1	E
10-Feb-2008	22:00	1.6	WSW
10-Feb-2008	23:00	1.5	SW
11-Feb-2008	00:00	1.2	SW
11-Feb-2008	01:00	0.6	W
11-Feb-2008	02:00	0.5	SW
11-Feb-2008	03:00	0.5	SW
11-Feb-2008	04:00	0.6	SW
11-Feb-2008	05:00	0.6	SSW
11-Feb-2008	06:00	0.6	SSW
11-Feb-2008	07:00	0.4	WNW
11-Feb-2008	08:00	0.4	W
11-Feb-2008	09:00	0.4	WNW
11-Feb-2008	10:00	0.9	W
11-Feb-2008	11:00	0.6	W
11-Feb-2008	12:00	0.9	W
11-Feb-2008	13:00	0.9	WNW
11-Feb-2008	14:00	1.2	W
11-Feb-2008	15:00	1.6	WNW
11-Feb-2008	16:00	1.6	WNW
11-Feb-2008	17:00	2.0	N
11-Feb-2008	18:00	2.5	N
11-Feb-2008	19:00	2.5	N
11-Feb-2008	20:00	2.7	N
11-Feb-2008	21:00	2.2	N
11-Feb-2008	22:00	1.5	NNE
11-Feb-2008	23:00	1.5	N
12-Feb-2008	00:00	1.5	NNE
12-Feb-2008	01:00	1.0	NNE
12-Feb-2008	02:00	0.9	NNE
12-Feb-2008	03:00	0.9	NNE
12-Feb-2008	04:00	0.9	NNE
12-Feb-2008	05:00	0.9	NNE

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
12-Feb-2008	06:00	0.9	NNE
12-Feb-2008	07:00	0.7	NNE
12-Feb-2008	08:00	0.9	NNE
12-Feb-2008	09:00	1.3	NE
12-Feb-2008	10:00	2.2	NE
12-Feb-2008	11:00	2.1	NNE
12-Feb-2008	12:00	2.2	NE
12-Feb-2008	13:00	2.8	NE
12-Feb-2008	14:00	2.8	NE
12-Feb-2008	15:00	1.4	NE
12-Feb-2008	16:00	1.4	ENE
12-Feb-2008	17:00	1.5	ENE
12-Feb-2008	18:00	2.5	NE
12-Feb-2008	19:00	1.9	NE
12-Feb-2008	20:00	1.0	NE
12-Feb-2008	21:00	2.2	NE
12-Feb-2008	22:00	2.5	NNE
12-Feb-2008	23:00	1.8	NE
13-Feb-2008	00:00	1.8	NNE
13-Feb-2008	01:00	2.5	NE
13-Feb-2008	02:00	2.5	NNE
13-Feb-2008	03:00	2.5	NE
13-Feb-2008	04:00	2.6	NNE
13-Feb-2008	05:00	3.3	NNE
13-Feb-2008	06:00	2.6	W
13-Feb-2008	07:00	3.0	WNW
13-Feb-2008	08:00	2.5	WNW
13-Feb-2008	09:00	2.4	W
13-Feb-2008	10:00	2.9	W
13-Feb-2008	11:00	3.0	N
13-Feb-2008	12:00	3.4	NE
13-Feb-2008	13:00	2.2	NNE
13-Feb-2008	14:00	1.6	NE
13-Feb-2008	15:00	2.5	NNE
13-Feb-2008	16:00	2.4	NNE
13-Feb-2008	17:00	2.5	W
13-Feb-2008	18:00	2.9	W
13-Feb-2008	19:00	3.4	NE
13-Feb-2008	20:00	2.4	W
13-Feb-2008	21:00	2.2	WNW
13-Feb-2008	22:00	2.2	N
13-Feb-2008	23:00	2.4	NNE
14-Feb-2008	00:00	2.8	W
14-Feb-2008	01:00	2.2	W
14-Feb-2008	02:00	1.2	SSW
14-Feb-2008	03:00	1.6	W
14-Feb-2008	04:00	1.6	W
14-Feb-2008	05:00	1.5	W
14-Feb-2008	06:00	1.6	W
14-Feb-2008	07:00	2.5	W
14-Feb-2008	08:00	2.5	W
14-Feb-2008	09:00	2.2	N
14-Feb-2008	10:00	1.9	N
14-Feb-2008	11:00	2.2	N

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
14-Feb-2008	12:00	1.8	N
14-Feb-2008	13:00	2.1	N
14-Feb-2008	14:00	1.9	N
14-Feb-2008	15:00	2.5	NNE
14-Feb-2008	16:00	2.8	N
14-Feb-2008	17:00	2.5	NNE
14-Feb-2008	18:00	2.8	NNE
14-Feb-2008	19:00	1.8	NNE
14-Feb-2008	20:00	1.6	NNE
14-Feb-2008	21:00	1.5	NNE
14-Feb-2008	22:00	2.1	NNE
14-Feb-2008	23:00	2.1	NNE
15-Feb-2008	00:00	1.8	NNE
15-Feb-2008	01:00	1.3	NNE
15-Feb-2008	02:00	1.2	NE
15-Feb-2008	03:00	0.9	NE
15-Feb-2008	04:00	0.9	NNE
15-Feb-2008	05:00	0.7	NE
15-Feb-2008	06:00	0.6	NE
15-Feb-2008	07:00	1.2	NE
15-Feb-2008	08:00	0.6	WNW
15-Feb-2008	09:00	0.6	SW
15-Feb-2008	10:00	0.6	WNW
15-Feb-2008	11:00	1.8	WNW
15-Feb-2008	12:00	1.6	WNW
15-Feb-2008	13:00	2.1	WNW
15-Feb-2008	14:00	1.6	WNW
15-Feb-2008	15:00	1.5	W
15-Feb-2008	16:00	2.2	SW
15-Feb-2008	17:00	2.2	WSW
15-Feb-2008	18:00	2.4	WNW
15-Feb-2008	19:00	1.3	WNW
15-Feb-2008	20:00	1.3	WNW
15-Feb-2008	21:00	1.0	WNW
15-Feb-2008	22:00	0.7	WNW
15-Feb-2008	23:00	0.7	WNW
16-Feb-2008	00:00	0.3	WNW
16-Feb-2008	01:00	0.0	---
16-Feb-2008	02:00	0.0	---
16-Feb-2008	03:00	0.0	---
16-Feb-2008	04:00	0.0	---
16-Feb-2008	05:00	0.0	---
16-Feb-2008	06:00	0.0	---
16-Feb-2008	07:00	1.2	WSW
16-Feb-2008	08:00	1.3	WSW
16-Feb-2008	09:00	1.5	SW
16-Feb-2008	10:00	1.9	WSW
16-Feb-2008	11:00	2.5	WSW
16-Feb-2008	12:00	2.9	WSW
16-Feb-2008	13:00	2.5	WNW
16-Feb-2008	14:00	2.4	WNW
16-Feb-2008	15:00	2.9	WNW
16-Feb-2008	16:00	2.9	WNW
16-Feb-2008	17:00	2.8	WNW

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
16-Feb-2008	18:00	2.5	WNW
16-Feb-2008	19:00	2.2	WNW
16-Feb-2008	20:00	1.6	W
16-Feb-2008	21:00	1.8	W
16-Feb-2008	22:00	1.8	W
16-Feb-2008	23:00	1.6	WSW
17-Feb-2008	00:00	2.1	WNW
17-Feb-2008	01:00	1.8	WSW
17-Feb-2008	02:00	1.6	WSW
17-Feb-2008	03:00	1.6	WNW
17-Feb-2008	04:00	1.8	WNW
17-Feb-2008	05:00	1.9	SW
17-Feb-2008	06:00	1.6	WNW
17-Feb-2008	07:00	2.1	WNW
17-Feb-2008	08:00	2.1	WNW
17-Feb-2008	09:00	2.5	WNW
17-Feb-2008	10:00	2.8	WNW
17-Feb-2008	11:00	2.6	WNW
17-Feb-2008	12:00	2.4	WNW
17-Feb-2008	13:00	2.4	WNW
17-Feb-2008	14:00	1.9	WNW
17-Feb-2008	15:00	1.8	W
17-Feb-2008	16:00	1.8	WNW
17-Feb-2008	17:00	1.8	W
17-Feb-2008	18:00	2.5	W
17-Feb-2008	19:00	2.4	WNW
17-Feb-2008	20:00	2.2	W
17-Feb-2008	21:00	2.4	WNW
17-Feb-2008	22:00	2.8	WSW
17-Feb-2008	23:00	2.2	WNW
18-Feb-2008	00:00	1.9	W
18-Feb-2008	01:00	2.2	WNW
18-Feb-2008	02:00	1.9	WNW
18-Feb-2008	03:00	2.1	SSW
18-Feb-2008	04:00	1.2	W
18-Feb-2008	05:00	1.5	W
18-Feb-2008	06:00	2.2	W
18-Feb-2008	07:00	2.8	WNW
18-Feb-2008	08:00	2.4	WNW
18-Feb-2008	09:00	3.3	WNW
18-Feb-2008	10:00	2.6	W
18-Feb-2008	11:00	2.5	W
18-Feb-2008	12:00	2.4	WNW
18-Feb-2008	13:00	2.2	WNW
18-Feb-2008	14:00	2.2	W
18-Feb-2008	15:00	2.8	W
18-Feb-2008	16:00	2.6	W
18-Feb-2008	17:00	1.4	W
18-Feb-2008	18:00	1.6	WNW
18-Feb-2008	19:00	2.1	WNW
18-Feb-2008	20:00	2.5	WNW
18-Feb-2008	21:00	2.2	W
18-Feb-2008	22:00	2.6	W
18-Feb-2008	23:00	3.0	WNW

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
19-Feb-2008	00:00	2.4	W
19-Feb-2008	01:00	1.8	NNE
19-Feb-2008	02:00	1.3	NNE
19-Feb-2008	03:00	2.2	NNE
19-Feb-2008	04:00	1.6	NE
19-Feb-2008	05:00	1.8	NE
19-Feb-2008	06:00	1.5	NNE
19-Feb-2008	07:00	1.2	NE
19-Feb-2008	08:00	1.6	NE
19-Feb-2008	09:00	1.6	NE
19-Feb-2008	10:00	1.8	NE
19-Feb-2008	11:00	1.8	ENE
19-Feb-2008	12:00	2.1	ENE
19-Feb-2008	13:00	2.8	NE
19-Feb-2008	14:00	3.0	NE
19-Feb-2008	15:00	2.5	NE
19-Feb-2008	16:00	2.4	NE
19-Feb-2008	17:00	1.5	NNE
19-Feb-2008	18:00	1.5	NE
19-Feb-2008	19:00	1.8	NNE
19-Feb-2008	20:00	2.1	NE
19-Feb-2008	21:00	2.2	NE
19-Feb-2008	22:00	2.5	NNE
19-Feb-2008	23:00	2.2	ENE
20-Feb-2008	00:00	2.2	NE
20-Feb-2008	01:00	2.4	ENE
20-Feb-2008	02:00	1.9	NE
20-Feb-2008	03:00	1.6	ENE
20-Feb-2008	04:00	2.6	ENE
20-Feb-2008	05:00	3.2	ESE
20-Feb-2008	06:00	2.5	W
20-Feb-2008	07:00	1.2	W
20-Feb-2008	08:00	2.1	W
20-Feb-2008	09:00	1.9	W
20-Feb-2008	10:00	2.2	E
20-Feb-2008	11:00	2.8	SSW
20-Feb-2008	12:00	3.0	W
20-Feb-2008	13:00	2.1	W
20-Feb-2008	14:00	2.6	W
20-Feb-2008	15:00	1.7	W
20-Feb-2008	16:00	2.6	W
20-Feb-2008	17:00	1.6	W
20-Feb-2008	18:00	1.8	W
20-Feb-2008	19:00	2.1	W
20-Feb-2008	20:00	2.1	W
20-Feb-2008	21:00	2.5	W
20-Feb-2008	22:00	2.5	W
20-Feb-2008	23:00	2.1	W
21-Feb-2008	00:00	2.1	W
21-Feb-2008	01:00	1.6	W
21-Feb-2008	02:00	1.3	W
21-Feb-2008	03:00	0.9	W
21-Feb-2008	04:00	1.3	W
21-Feb-2008	05:00	1.9	W

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
21-Feb-2008	06:00	2.2	W
21-Feb-2008	07:00	1.2	W
21-Feb-2008	08:00	1.3	W
21-Feb-2008	09:00	1.6	W
21-Feb-2008	10:00	1.6	SSW
21-Feb-2008	11:00	1.2	W
21-Feb-2008	12:00	1.6	WSW
21-Feb-2008	13:00	2.4	WSW
21-Feb-2008	14:00	2.4	W
21-Feb-2008	15:00	2.6	SW
21-Feb-2008	16:00	1.8	SW
21-Feb-2008	17:00	2.1	SW
21-Feb-2008	18:00	2.6	W
21-Feb-2008	19:00	3.0	SW
21-Feb-2008	20:00	2.9	WSW
21-Feb-2008	21:00	2.4	W
21-Feb-2008	22:00	1.9	WSW
21-Feb-2008	23:00	1.5	W
22-Feb-2008	00:00	1.5	WSW
22-Feb-2008	01:00	1.2	SW
22-Feb-2008	02:00	0.9	SW
22-Feb-2008	03:00	0.9	SW
22-Feb-2008	04:00	1.0	SSW
22-Feb-2008	05:00	0.7	SW
22-Feb-2008	06:00	0.9	SW
22-Feb-2008	07:00	0.6	SW
22-Feb-2008	08:00	0.4	SW
22-Feb-2008	09:00	0.6	W
22-Feb-2008	10:00	0.9	WSW
22-Feb-2008	11:00	1.0	WSW
22-Feb-2008	12:00	1.0	SW
22-Feb-2008	13:00	1.0	SSW
22-Feb-2008	14:00	0.9	SW
22-Feb-2008	15:00	1.2	WSW
22-Feb-2008	16:00	1.8	W
22-Feb-2008	17:00	1.8	WSW
22-Feb-2008	18:00	1.6	SW
22-Feb-2008	19:00	1.2	SW
22-Feb-2008	20:00	1.5	WSW
22-Feb-2008	21:00	1.0	WSW
22-Feb-2008	22:00	0.9	SW
22-Feb-2008	23:00	0.9	SW
23-Feb-2008	00:00	1.8	WSW
23-Feb-2008	01:00	1.2	WSW
23-Feb-2008	02:00	1.5	SW
23-Feb-2008	03:00	1.2	WSW
23-Feb-2008	04:00	1.2	SW
23-Feb-2008	05:00	1.3	WSW
23-Feb-2008	06:00	1.5	WSW
23-Feb-2008	07:00	1.3	W
23-Feb-2008	08:00	0.9	W
23-Feb-2008	09:00	0.7	W
23-Feb-2008	10:00	0.6	W
23-Feb-2008	11:00	0.6	W

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
23-Feb-2008	12:00	1.2	W
23-Feb-2008	13:00	0.9	SW
23-Feb-2008	14:00	1.2	SW
23-Feb-2008	15:00	0.9	W
23-Feb-2008	16:00	2.2	W
23-Feb-2008	17:00	1.6	W
23-Feb-2008	18:00	1.2	W
23-Feb-2008	19:00	0.7	W
23-Feb-2008	20:00	0.4	W
23-Feb-2008	21:00	0.7	W
23-Feb-2008	22:00	0.6	W
23-Feb-2008	23:00	1.2	W
24-Feb-2008	00:00	0.9	WSW
24-Feb-2008	01:00	1.2	W
24-Feb-2008	02:00	1.2	WNW
24-Feb-2008	03:00	1.9	W
24-Feb-2008	04:00	1.8	W
24-Feb-2008	05:00	1.5	W
24-Feb-2008	06:00	1.5	W
24-Feb-2008	07:00	1.0	W
24-Feb-2008	08:00	1.0	W
24-Feb-2008	09:00	0.7	W
24-Feb-2008	10:00	0.3	W
24-Feb-2008	11:00	0.3	W
24-Feb-2008	12:00	1.5	W
24-Feb-2008	13:00	2.2	SSW
24-Feb-2008	14:00	2.2	SSW
24-Feb-2008	15:00	2.1	SW
24-Feb-2008	16:00	1.6	SW
24-Feb-2008	17:00	2.5	WSW
24-Feb-2008	18:00	1.9	WNW
24-Feb-2008	19:00	2.6	WNW
24-Feb-2008	20:00	2.0	WNW
24-Feb-2008	21:00	1.8	WNW
24-Feb-2008	22:00	1.6	WNW
24-Feb-2008	23:00	1.9	WSW
25-Feb-2008	00:00	1.5	WSW
25-Feb-2008	01:00	1.2	WNW
25-Feb-2008	02:00	1.5	WNW
25-Feb-2008	03:00	0.7	SW
25-Feb-2008	04:00	1.0	WSW
25-Feb-2008	05:00	1.8	W
25-Feb-2008	06:00	1.6	WNW
25-Feb-2008	07:00	1.5	WNW
25-Feb-2008	08:00	1.2	WNW
25-Feb-2008	09:00	0.9	W
25-Feb-2008	10:00	0.6	W
25-Feb-2008	11:00	1.3	SW
25-Feb-2008	12:00	1.8	W
25-Feb-2008	13:00	2.5	W
25-Feb-2008	14:00	2.6	WSW
25-Feb-2008	15:00	1.9	SSW
25-Feb-2008	16:00	1.9	SW
25-Feb-2008	17:00	2.5	W

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
25-Feb-2008	18:00	2.8	SW
25-Feb-2008	19:00	2.2	WSW
25-Feb-2008	20:00	2.2	SW
25-Feb-2008	21:00	2.1	WSW
25-Feb-2008	22:00	2.8	WSW
25-Feb-2008	23:00	2.5	WSW
26-Feb-2008	00:00	2.5	WSW
26-Feb-2008	01:00	2.6	WSW
26-Feb-2008	02:00	1.9	WNW
26-Feb-2008	03:00	1.7	WNW
26-Feb-2008	04:00	2.2	WNW
26-Feb-2008	05:00	2.8	WNW
26-Feb-2008	06:00	2.9	WNW
26-Feb-2008	07:00	3.0	WNW
26-Feb-2008	08:00	3.2	WNW
26-Feb-2008	09:00	2.8	WNW
26-Feb-2008	10:00	2.9	WNW
26-Feb-2008	11:00	2.9	WSW
26-Feb-2008	12:00	3.5	WSW
26-Feb-2008	13:00	3.8	WNW
26-Feb-2008	14:00	3.4	WNW
26-Feb-2008	15:00	4.3	WNW
26-Feb-2008	16:00	4.0	WNW
26-Feb-2008	17:00	3.8	WNW
26-Feb-2008	18:00	4.0	WNW
26-Feb-2008	19:00	3.3	WNW
26-Feb-2008	20:00	2.9	WNW
26-Feb-2008	21:00	3.4	WNW
26-Feb-2008	22:00	3.6	WNW
26-Feb-2008	23:00	3.2	WNW
27-Feb-2008	00:00	3.7	WNW
27-Feb-2008	01:00	3.4	WNW
27-Feb-2008	02:00	2.6	WNW
27-Feb-2008	03:00	2.5	W
27-Feb-2008	04:00	2.4	W
27-Feb-2008	05:00	2.9	W
27-Feb-2008	06:00	3.1	WSW
27-Feb-2008	07:00	3.3	SW
27-Feb-2008	08:00	3.4	SW
27-Feb-2008	09:00	3.4	WSW
27-Feb-2008	10:00	3.7	W
27-Feb-2008	11:00	3.1	SW
27-Feb-2008	12:00	3.1	SW
27-Feb-2008	13:00	3.1	WNW
27-Feb-2008	14:00	3.4	WNW
27-Feb-2008	15:00	3.5	WNW
27-Feb-2008	16:00	3.8	WNW
27-Feb-2008	17:00	3.3	WNW
27-Feb-2008	18:00	2.8	WNW
27-Feb-2008	19:00	3.1	W
27-Feb-2008	20:00	3.2	SW
27-Feb-2008	21:00	3.1	W
27-Feb-2008	22:00	2.8	WNW
27-Feb-2008	23:00	1.8	WNW

Appendix D - Wind Data

Date	Time	Wind Speed m/s	Direction
28-Feb-2008	00:00	2.8	WNW
28-Feb-2008	01:00	2.2	WNW
28-Feb-2008	02:00	1.5	W
28-Feb-2008	03:00	1.3	WSW
28-Feb-2008	04:00	1.6	WSW
28-Feb-2008	05:00	1.2	WSW
28-Feb-2008	06:00	1.0	WNW
28-Feb-2008	07:00	1.2	WSW
28-Feb-2008	08:00	1.9	WNW
28-Feb-2008	09:00	1.8	WSW
28-Feb-2008	10:00	1.8	WSW
28-Feb-2008	11:00	1.8	W
28-Feb-2008	12:00	1.9	WNW
28-Feb-2008	13:00	2.1	WNW
28-Feb-2008	14:00	2.5	WNW
28-Feb-2008	15:00	2.4	WNW
28-Feb-2008	16:00	1.8	WNW
28-Feb-2008	17:00	2.1	SW
28-Feb-2008	18:00	1.9	WSW
28-Feb-2008	19:00	2.2	WSW
28-Feb-2008	20:00	2.9	SW
28-Feb-2008	21:00	2.2	W
28-Feb-2008	22:00	2.1	W
28-Feb-2008	23:00	2.9	SW
29-Feb-2008	00:00	2.7	WNW
29-Feb-2008	01:00	2.2	WNW
29-Feb-2008	02:00	2.2	WNW
29-Feb-2008	03:00	3.1	W
29-Feb-2008	04:00	3.6	W
29-Feb-2008	05:00	2.7	W
29-Feb-2008	06:00	1.8	WSW
29-Feb-2008	07:00	1.8	SW
29-Feb-2008	08:00	1.3	SW
29-Feb-2008	09:00	1.3	WSW
29-Feb-2008	10:00	1.3	W
29-Feb-2008	11:00	0.4	SW
29-Feb-2008	12:00	0.4	SW
29-Feb-2008	13:00	0.4	WNW
29-Feb-2008	14:00	0.0	---
29-Feb-2008	15:00	0.0	---
29-Feb-2008	16:00	0.0	---
29-Feb-2008	17:00	2.0	SW
29-Feb-2008	18:00	2.0	SW
29-Feb-2008	19:00	1.1	WSW
29-Feb-2008	20:00	2.0	SW
29-Feb-2008	21:00	1.6	S
29-Feb-2008	22:00	1.1	WSW
29-Feb-2008	23:00	0.7	W

**APPENDIX E
1-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix E - 1-hour TSP Monitoring Results



Location AM 3 - Garden Villa

Date	Weather Condition	Filter Weight (g)		Flow Rate (m ³ /min.)		Elapse Time		Air Temp. (K)	Atmospheric Pressure(Pa)	Particulate weight(g)	Av. flow (m ³ /min)	Total vol. (m ³)	Sampling Time(hrs.)	Conc. (µg/m ³)
		Initial	Final	Initial	Final	Initial	Final							
4-Feb-08	Cloudy	2.8117	2.8209	1.22	1.22	7029.0	7030.0	281.3	769.4	0.0092	1.22	73.4	1.0	125.4
5-Feb-08	Cloudy	2.8062	2.8145	1.21	1.21	7054.0	7055.0	284.3	766.0	0.0083	1.21	72.9	1.0	113.9
6-Feb-08	Cloudy	2.8082	2.8165	1.22	1.22	7055.0	7056.0	281.7	769.1	0.0083	1.22	73.3	1.0	113.2
12-Feb-08	Sunny	2.8486	2.8572	1.22	1.22	7056.0	7057.0	282.1	772.1	0.0086	1.22	73.4	1.0	117.2
13-Feb-08	Cloudy	2.8045	2.8137	1.22	1.22	7081.0	7082.0	286.2	773.5	0.0092	1.22	73.3	1.0	125.4
14-Feb-08	Cloudy	2.8068	2.8143	1.22	1.22	7082.0	7083.0	285.2	772.3	0.0075	1.22	73.0	1.0	102.7
19-Feb-08	Sunny	2.8092	2.8145	1.22	1.22	7107.0	7108.0	286.2	773.0	0.0053	1.22	73.0	1.0	72.6
20-Feb-08	Sunny	2.8698	2.8791	1.21	1.21	7108.0	7109.0	287.6	772.1	0.0093	1.21	72.8	1.0	127.8
21-Feb-08	Sunny	2.9192	2.9279	1.21	1.21	7109.0	7110.0	288.3	770.1	0.0087	1.21	72.6	1.0	119.8
25-Feb-08	Cloudy	2.8021	2.8140	1.21	1.21	7134.0	7135.0	288.1	769.1	0.0119	1.21	72.6	1.0	163.9
26-Feb-08	Cloudy	2.7758	2.7840	1.21	1.21	7135.0	7136.0	290.1	767.9	0.0082	1.21	72.3	1.0	113.4
28-Feb-08	Sunny	2.7695	2.7840	1.22	1.22	7136.0	7137.0	286.1	771.2	0.0145	1.22	72.9	1.0	198.9
													Min	72.6
													Max	198.9
													Average	124.5

Location AM 4 - Government Quarters

Date	Weather Condition	Filter Weight (g)		Flow Rate (m ³ /min.)		Elapse Time		Air Temp. (K)	Atmospheric Pressure(Pa)	Particulate weight(g)	Av. flow (m ³ /min)	Total vol. (m ³)	Sampling Time(hrs.)	Conc. (µg/m ³)
		Initial	Final	Initial	Final	Initial	Final							
4-Feb-08	Cloudy	2.8391	2.8414	1.25	1.25	6974.5	6975.5	281.2	769.4	0.0023	1.25	75.2	1.0	30.6
5-Feb-08	Cloudy	2.8715	2.8732	1.25	1.25	6999.5	7000.5	283.5	767.3	0.0017	1.25	75.1	1.0	22.6
6-Feb-08	Cloudy	2.8296	2.8309	1.25	1.25	7000.5	7001.5	281.7	769.1	0.0013	1.25	75.1	1.0	17.3
12-Feb-08	Sunny	2.7922	2.8004	1.25	1.25	7001.5	7002.5	282.1	772.1	0.0082	1.25	75.2	1.0	109.1
13-Feb-08	Cloudy	2.7662	2.7739	1.25	1.55	7026.5	7027.5	284.1	771.1	0.0077	1.40	74.9	1.0	102.8
14-Feb-08	Cloudy	2.7490	2.7547	1.25	1.25	7027.5	7028.5	285.2	772.3	0.0057	1.25	74.8	1.0	76.2
19-Feb-08	Sunny	2.7754	2.7803	1.25	1.25	7052.5	7053.5	286.2	773.0	0.0049	1.25	74.7	1.0	65.6
20-Feb-08	Sunny	2.7928	2.7946	1.24	1.24	7053.5	7054.5	287.6	772.1	0.0018	1.24	74.5	1.0	24.2
21-Feb-08	Sunny	2.7907	2.8010	1.24	1.24	7054.5	7055.5	288.3	770.1	0.0103	1.24	74.3	1.0	138.6
25-Feb-08	Cloudy	2.9019	2.9061	1.24	1.24	7079.5	7080.5	288.1	769.1	0.0042	1.24	74.3	1.0	56.5
26-Feb-08	Cloudy	2.8524	2.8614	1.23	1.23	7080.5	7081.5	290.1	767.9	0.0090	1.23	74.0	1.0	121.6
28-Feb-08	Sunny	2.8438	2.8572	1.24	1.24	7081.5	7082.5	286.1	771.2	0.0134	1.24	74.7	1.0	179.5
													Min	17.3
													Max	179.5
													Average	78.7

1-hr TSP Levels

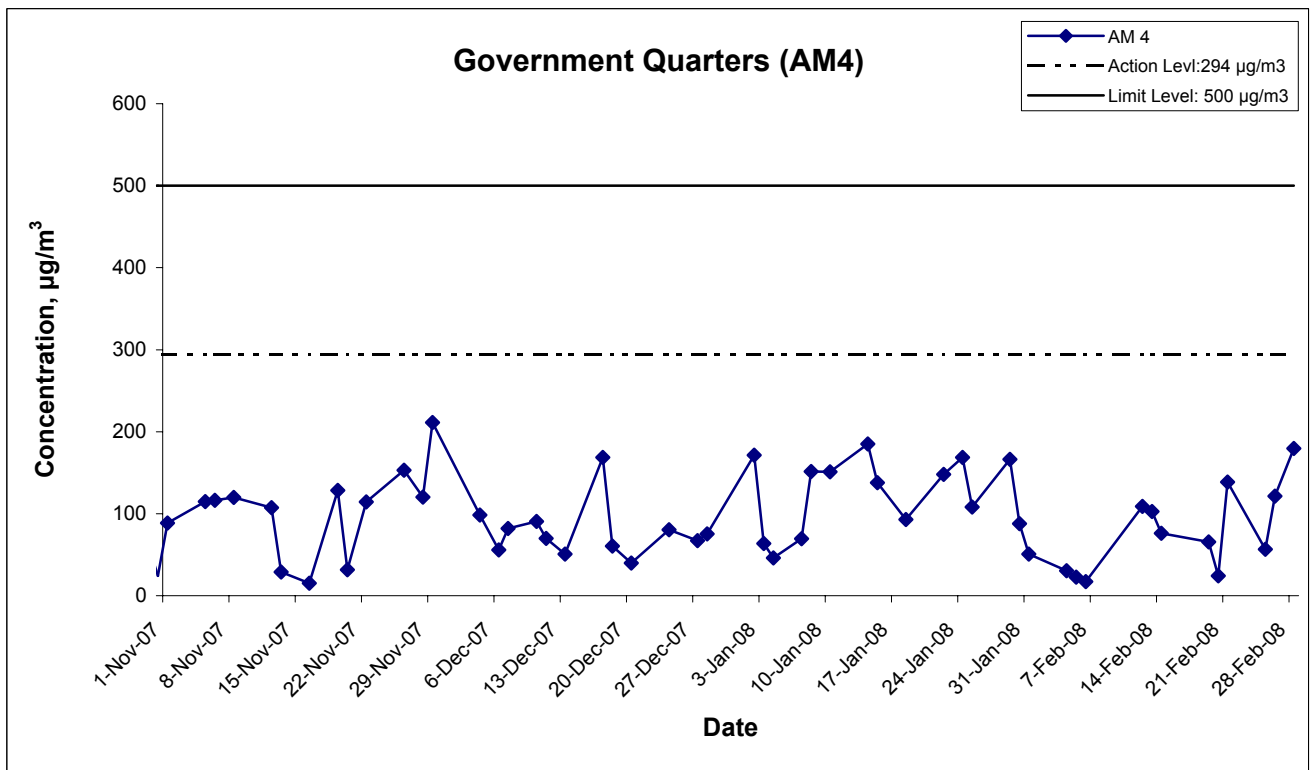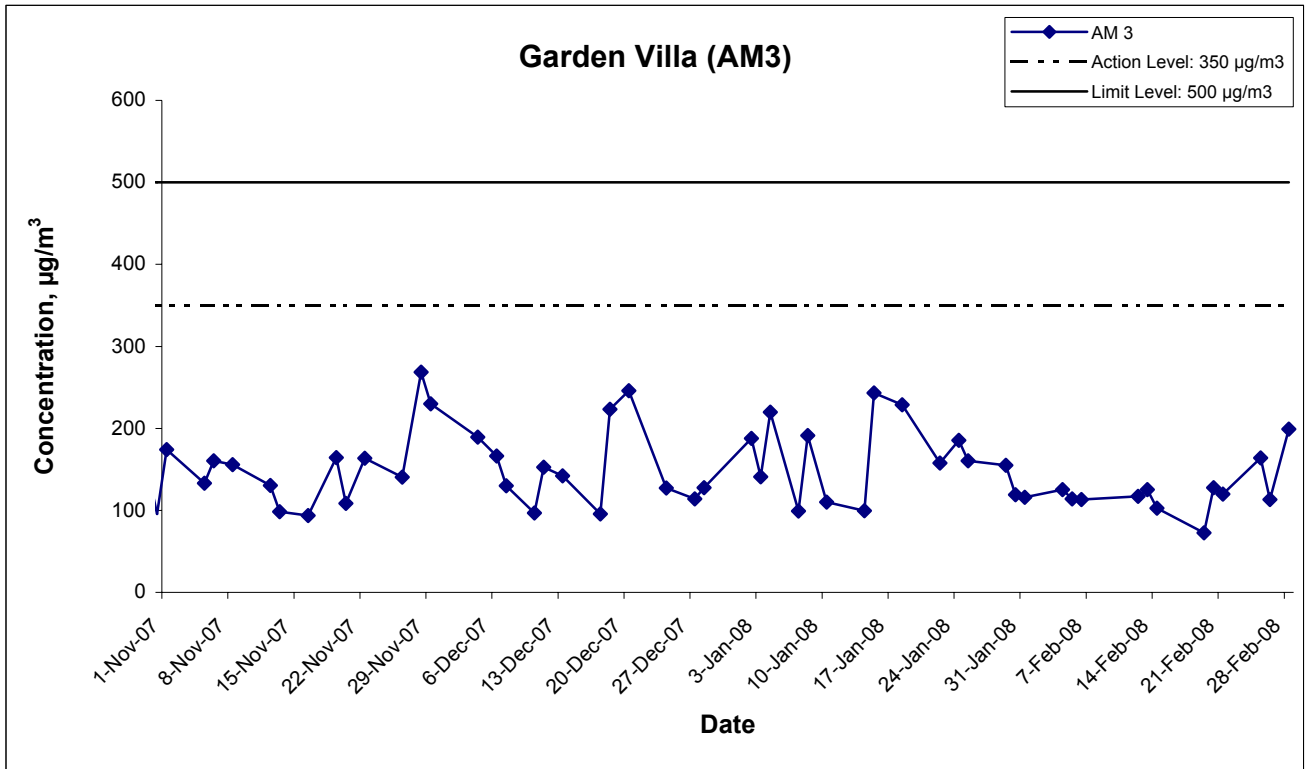

Title Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin Contract HY/2003/02 - Eagle's Nest Tunnel and Associated Works Graphical Presentation of 1-hour TSP Impact Monitoring Results	Scale N.T.S	Project No. MA3024	
	Date Feb 08	Appendix E	

**APPENDIX F
24-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix F - 24-hour TSP Monitoring Results



Location AM 3 - Garden Villa

Date	Weather Condition	Filter Weight (g)		Flow Rate (m ³ /min.)		Elapse Time		Air Temp. (K)	Atmospheric Pressure(Pa)	Particulate weight(g)	Av. flow (m ³ /min)	Total vol. (m ³)	Sampling Time(hrs.)	Conc. (µg/m ³)
		Initial	Final	Initial	Final	Initial	Final							
4-Feb-08	Cloudy	2.8327	2.9044	1.22	1.22	7030.0	7054.0	281.4	769.1	0.0717	1.22	1759.7	24.0	40.7
12-Feb-08	Cloudy	2.8157	2.9321	1.22	1.22	7057.0	7081.0	282.3	771.9	0.1164	1.22	1760.1	24.0	66.1
18-Feb-08	Cloudy	2.8445	3.0005	1.21	1.21	7083.0	7107.0	288.1	772.7	0.1560	1.21	1745.6	24.0	89.4
23-Feb-08	Cloudy	2.8235	2.9482	1.20	1.20	7110.0	7134.0	290.2	767.1	0.1247	1.20	1734.7	24.0	71.9
29-Feb-08	Sunny	2.8362	3.0171	1.21	1.21	7137.0	7161.0	287.3	767.1	0.1809	1.21	1742.2	24.0	103.8
													Min	40.7
													Max	103.8
													Average	74.4

Location AM 4 - Government Quarters

Date	Weather Condition	Filter Weight (g)		Flow Rate (m ³ /min.)		Elapse Time		Air Temp. (K)	Atmospheric Pressure(Pa)	Particulate weight(g)	Av. flow (m ³ /min)	Total vol. (m ³)	Sampling Time(hrs.)	Conc. (µg/m ³)
		Initial	Final	Initial	Final	Initial	Final							
4-Feb-08	Cloudy	2.7947	2.8290	1.25	1.25	6975.5	6999.5	281.4	769.2	0.0343	1.25	1803.4	24.0	19.0
12-Feb-08	Cloudy	2.8118	2.8986	1.25	1.25	7002.5	7026.5	282.3	771.9	0.0868	1.25	1803.7	24.0	48.1
18-Feb-08	Cloudy	2.7868	2.8210	1.24	1.24	7028.5	7052.5	288.1	772.7	0.0342	1.24	1787.5	24.0	19.1
23-Feb-08	Cloudy	2.7699	2.8700	1.23	1.23	7055.5	7079.5	1595.7	767.1	0.1001	1.23	1775.4	24.0	56.4
29-Feb-08	Sunny	2.7762	2.9241	1.24	1.24	7082.5	7106.5	287.3	767.1	0.1479	1.24	1783.7	24.0	82.9
													Min	19.0
													Max	82.9
													Average	45.1

24-hr TSP Levels

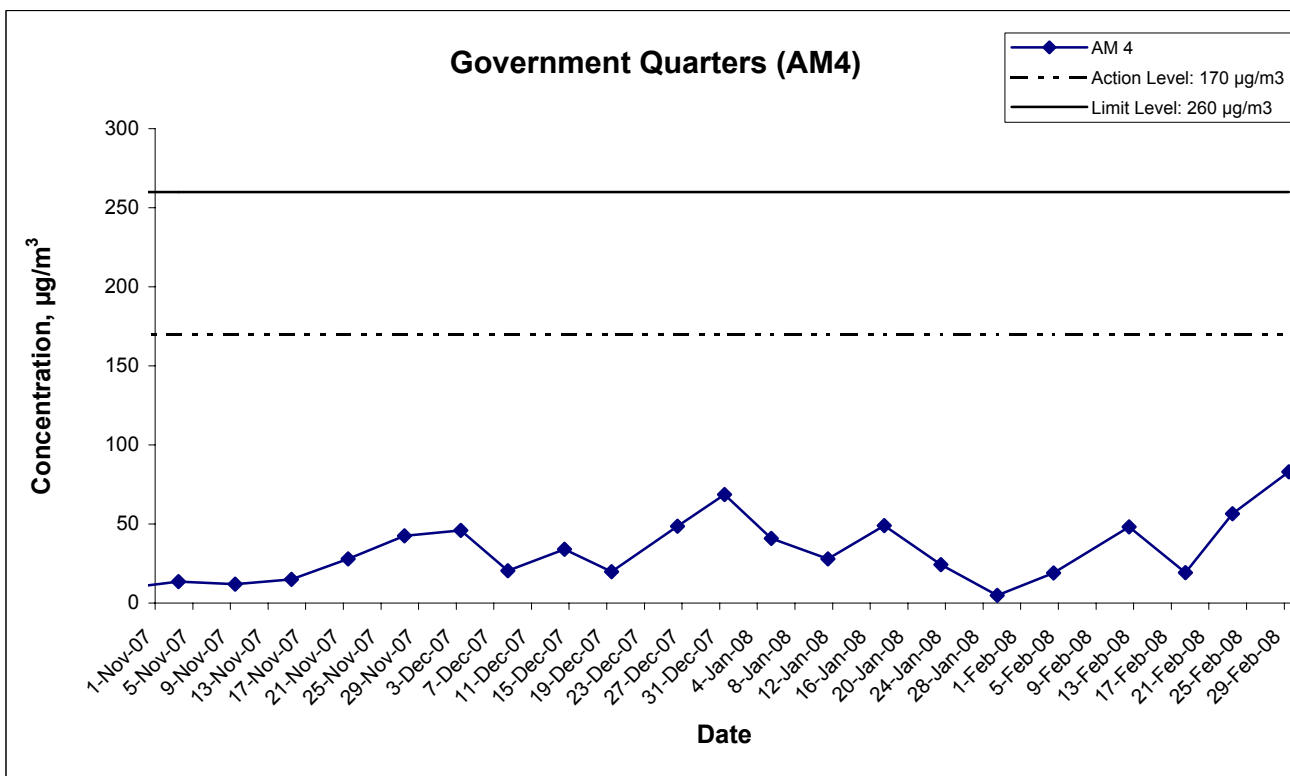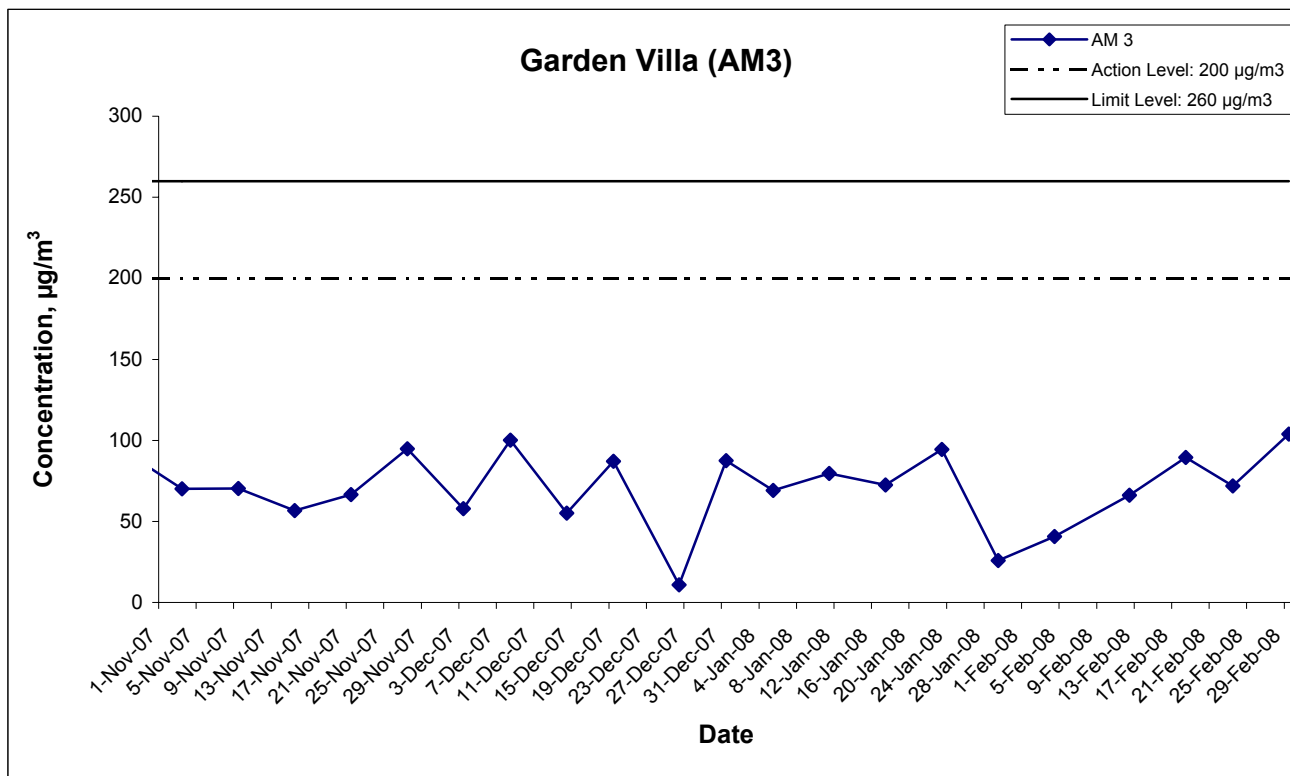

Title Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin Contract HY/2003/02 - Eagle's Nest Tunnel and Associated Works Graphical Presentation of 24-hour TSP Impact Monitoring Results	Scale N.T.S	Project No. MA3024	
	Date Feb 08	Appendix F	

**APPENDIX G
NOISE MONITORING RESULTS AND
GRAPHICAL PRESENTATION**

Appendix G - Noise Monitoring Results

Location NM5 - Villa Carlton								
Date	Time	Weather	Unit: dB (A) (30-min)					Remarks
			Measured Noise Level			Baseline Level	Construction Noise Level	
			L _{eq}	L ₁₀	L ₉₀	L _{eq}	L _{eq}	
6-Feb-08	15:00	Cloudy	75.2	78.0	70.5	77.1	75.2, Measured ≤ Baseline	The major noise source was identified as traffic noise from Tai Po Road.
14-Feb-08	10:30	Cloudy	76.7	78.5	70.0		76.7, Measured ≤ Baseline	
20-Feb-08	09:00	Sunny	75.8	77.5	71.5		75.8, Measured ≤ Baseline	
28-Feb-08	13:00	Sunny	74.4	77.5	70.5		74.4, Measured ≤ Baseline	

Location NM6 - Government Quarters						
Date	Time	Weather	Unit: dB (A) (30-min)			Remarks
			Measured Noise Level			
			L _{eq}	L ₁₀	L ₉₀	
6-Feb-08	15:40	Cloudy	53.8	54.5	49.0	-
14-Feb-08	11:20	Cloudy	62.7	65.5	57.0	
20-Feb-08	09:40	Sunny	54.2	55.5	49.5	
28-Feb-08	13:40	Sunny	53.8	55.0	49.0	

Location NM7 - Garden Vilia								
Date	Time	Weather	Unit: dB (A) (30-min)					Remarks
			Measured Noise Level			Baseline Level	Construction Noise Level	
			L _{eq}	L ₁₀	L ₉₀	L _{eq}	L _{eq}	
6-Feb-08	16:25	Cloudy	67.3	69.5	62.0	59.0	66.6	-
14-Feb-08	15:40	Cloudy	73.8	76.5	67.5		73.7	
20-Feb-08	10:30	Sunny	67.6	69.5	63.5		67.0	
28-Feb-08	14:25	Sunny	68.1	70.5	64.5		67.5	

Construction Noise Level (Leq) = Measured Noise Level (Leq) - Baseline Noise Level (Leq)

*Bolted value indicated limit level exceedance

Appendix G - Noise Monitoring Results

Restricted Hours - 19:00 to 23:00 on normal weekdays

Location NM5 - Villa Carlton										
Date	Time	Weather	dB (A) (5-min)				Average L _{eq}	Baseline Level	Construction Noise Level	Remarks
			L _{eq}	L ₁₀	L ₉₀	L _{eq}		L _{eq}		
6-Feb-08	20:20	Cloudy	72.1	76.0	68.5	72.2	75.8	72.2, Measured ≤ Baseline	The major noise source was identified as traffic noise from Tai Po Road.	
	20:25		72.3	76.0	68.5					
	20:30		72.3	76.0	68.5					
14-Feb-08	20:15	Cloudy	71.7	74.5	67.5	71.8				
	20:20		71.6	74.5	67.5					
	20:25		72.1	75.0	68.0					
20-Feb-08	20:20	Cloudy	72.6	78.0	68.5	72.2				
	20:25		72.1	77.0	68.0					
	20:30		72.0	77.0	68.0					
28-Feb-08	20:15	Cloudy	71.5	76.5	68.0	71.5				
	20:20		71.6	76.5	68.0					
	20:25		71.3	76.0	67.5					

Location NM6 - Government Quarters										
Date	Time	Weather	dB (A) (5-min)				Average L _{eq}	Baseline Level	Construction Noise Level	Remarks
			L _{eq}	L ₁₀	L ₉₀	L _{eq}		L _{eq}		
6-Feb-08	19:45	Cloudy	51.3	55.0	47.5	51.6	56.1	51.6, Measured ≤ Baseline	-	
	19:50		51.7	55.5	48.0					
	19:55		51.0	55.0	47.5					
14-Feb-08	19:45	Cloudy	54.2	58.5	51.0	54.0				
	19:50		54.0	58.0	51.0					
	19:55		53.8	58.0	51.0					
20-Feb-08	19:45	Cloudy	52.7	55.5	49.5	52.7				
	19:50		52.6	55.5	49.5					
	19:55		52.9	55.5	49.5					
28-Feb-08	19:45	Cloudy	53.0	58.0	49.0	53.2				
	19:50		53.6	58.0	49.5					
	19:55		53.1	58.0	49.0					

Location NM7 - Garden Villa										
Date	Time	Weather	dB (A) (5-min)				Average L _{eq}	Baseline Level	Construction Noise Level	Remarks
			L _{eq}	L ₁₀	L ₉₀	L _{eq}		L _{eq}		
6-Feb-08	19:00	Cloudy	52.6	56.0	50.0	52.5	58.3	52.5, Measured ≤ Baseline	The major noise source was identified as traffic noise from Tai Po Road.	
	19:05		52.7	56.0	50.0					
	19:10		52.3	56.0	50.0					
14-Feb-08	19:00	Cloudy	55.2	59.0	51.0	54.8				
	19:05		54.7	58.5	50.5					
	19:10		54.7	58.5	50.5					
20-Feb-08	19:00	Cloudy	56.7	59.5	52.0	56.2				
	19:05		55.8	58.0	51.5					
	19:10		56.1	59.0	51.5					
28-Feb-08	19:00	Cloudy	54.0	59.0	50.0	54.5				
	19:05		54.8	59.5	50.5					
	19:10		54.7	59.5	50.5					

Construction Noise Level (Leq) = Measured Noise Level (Leq) - Baseline Noise Level (Leq)

*Bolted value indicated limit level exceedance

Appendix G - Noise Monitoring Results

Restricted Hours - 23:00 to 07:00 on normal weekdays

Location NM5 - Villa Carlton										
Date	Time	Weather	dB (A) (5-min)				Average L _{eq}	Baseline Level	Construction Noise Level	Remarks
			L _{eq}	L ₁₀	L ₉₀	L _{eq}		L _{eq}		
6-Feb-08	23:00	Cloudy	71.9	74.0	68.0	71.6	74.3	71.6, Measured ≤ Baseline	The major noise source was identified as traffic noise from Tai Po Road.	
	23:05		71.7	74.0	68.0					
	23:10		71.7	74.0	68.0					
14-Feb-08	23:00	Cloudy	72.0	76.0	67.0	71.8				
	23:05		71.6	76.0	67.0					
	23:10		71.9	76.0	67.0					
20-Feb-08	23:00	Cloudy	71.6	74.5	68.0	71.6				
	23:05		71.5	74.5	68.0					
	23:10		71.6	74.5	68.0					
28-Feb-08	23:00	Cloudy	71.6	74.0	67.5	71.6				
	23:05		71.7	74.0	67.5					
	23:10		71.4	74.0	67.5					




Location NM6 - Government Quarters										
Date	Time	Weather	dB (A) (5-min)				Average L _{eq}	Baseline Level	Construction Noise Level	Remarks
			L _{eq}	L ₁₀	L ₉₀	L _{eq}		L _{eq}		
6-Feb-08	23:25	Cloudy	51.2	54.0	46.5	51.4	52.8	51.4, Measured ≤ Baseline	The noise monitoring results are well within the range of Baseline Monitoring Level and there is no evidence showing that the dominant noise was generated from the construction activities.	
	23:30		51.6	54.0	47.0					
	23:35		51.3	54.0	46.5					
14-Feb-08	23:25	Cloudy	51.3	54.5	47.0	51.2				
	23:30		51.2	54.5	47.0					
	23:35		51.0	54.5	47.0					
20-Feb-08	23:25	Cloudy	50.3	54.0	47.0	50.4				
	23:30		50.4	54.0	47.0					
	23:35		50.4	54.0	47.0					
28-Feb-08	23:25	Cloudy	50.6	54.0	46.5	50.7				
	23:30		50.7	54.0	46.5					
	23:35		50.9	54.0	46.5					

Location NM7 - Garden Villa										
Date	Time	Weather	dB (A) (5-min)				Average L _{eq}	Baseline Level	Construction Noise Level	Remarks
			L _{eq}	L ₁₀	L ₉₀	L _{eq}		L _{eq}		
6-Feb-08	23:50	Cloudy	52.7	55.0	49.0	52.8	56.5	52.8, Measured ≤ Baseline	The major noise source was identified as traffic noise from Tai Po Road.	
	23:55		52.8	55.0	49.0					
	00:00		52.9	55.0	49.0					
14-Feb-08	23:50	Cloudy	51.7	55.0	48.0	51.5				
	23:55		51.4	54.5	47.5					
	00:00		51.4	54.5	47.5					
20-Feb-08	23:50	Cloudy	52.5	56.5	48.0	52.7				
	20:55		52.6	56.5	48.5					
	00:00		52.9	56.5	49.0					
28-Feb-08	23:50	Cloudy	52.8	54.5	47.0	53.4				
	23:55		53.7	54.5	47.0					
	00:00		53.6	54.5	47.0					

Construction Noise Level (Leq) = Measured Noise Level (Leq) - Baseline Noise Level (Leq)

*Bolted value indicated limit level exceedance




Noise Levels

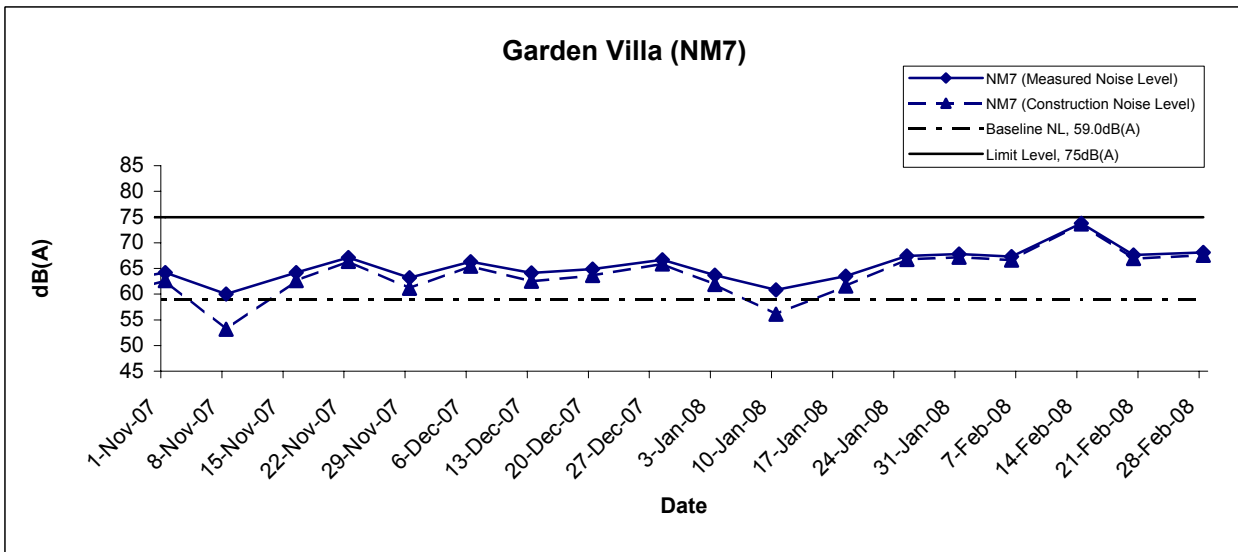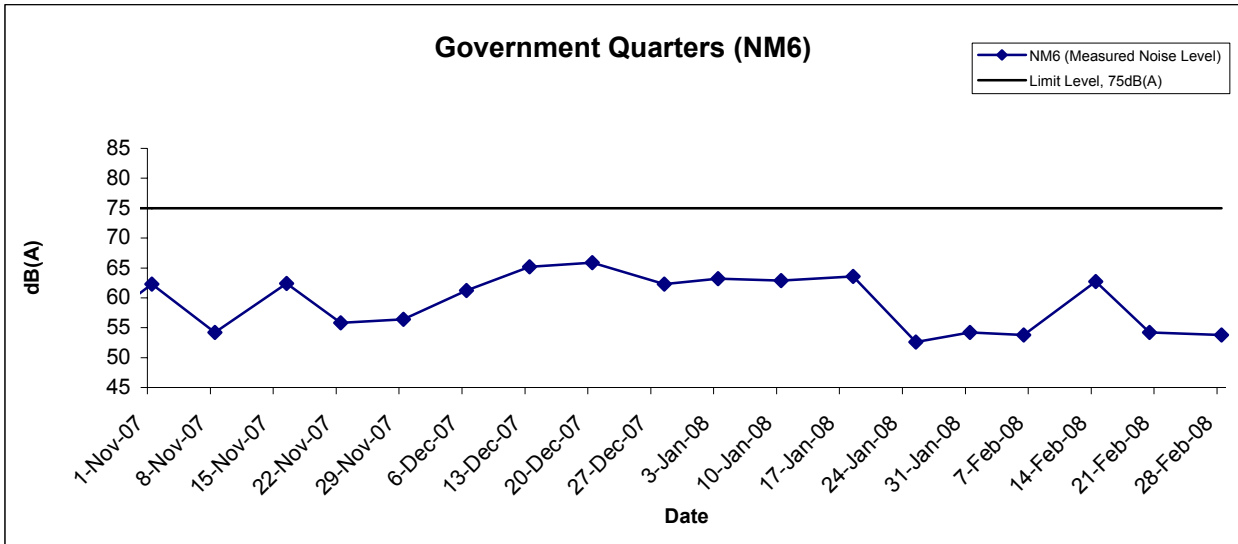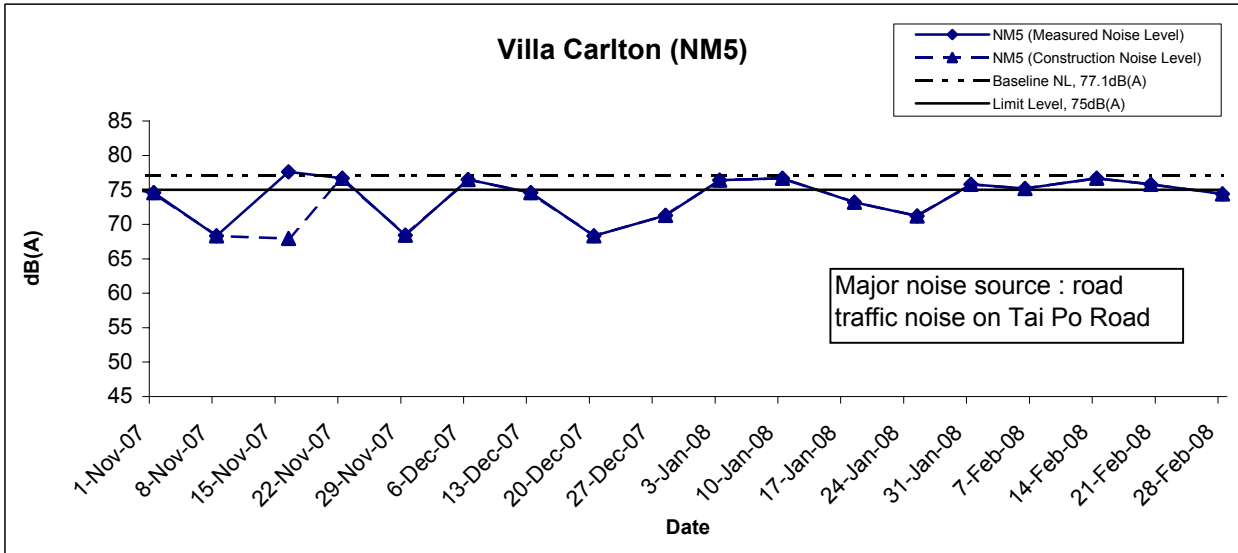

* Construction Noise Level = Measured Noise Level - Baseline Level
 (If the measured noise level is lower than the baseline level, the construction noise level will be taken as the measured one)

Title Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin Contract HY/2003/02 - Eagle's Nest Tunnel and Associated Works Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA3024	CINOTECH
	Date Feb 08	Appendix G	




Restricted Hours (19:00 to 23:00) - Noise Levels

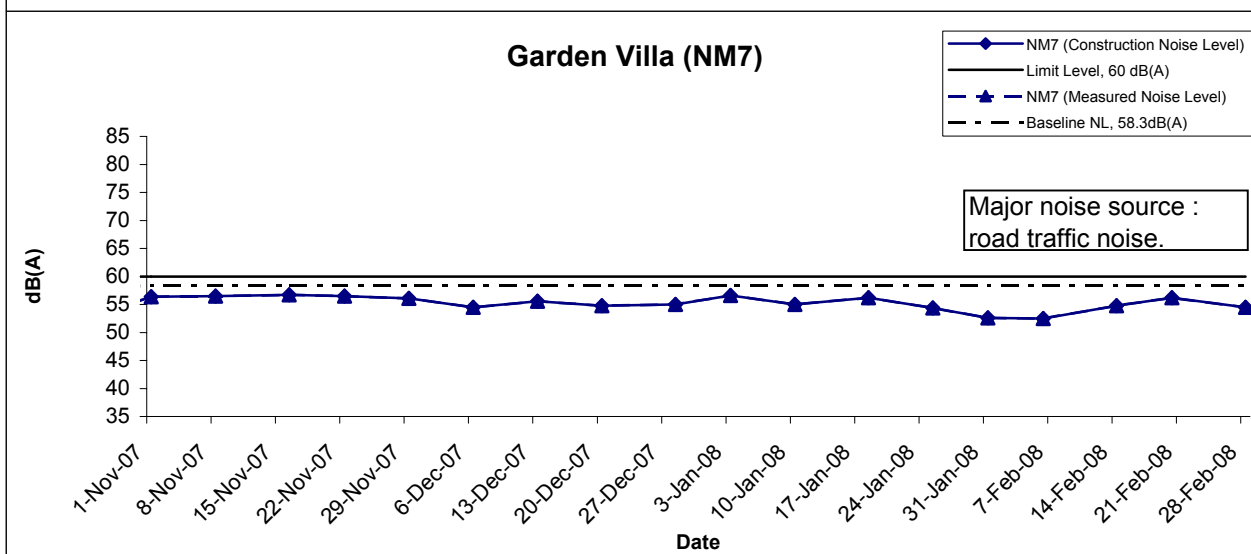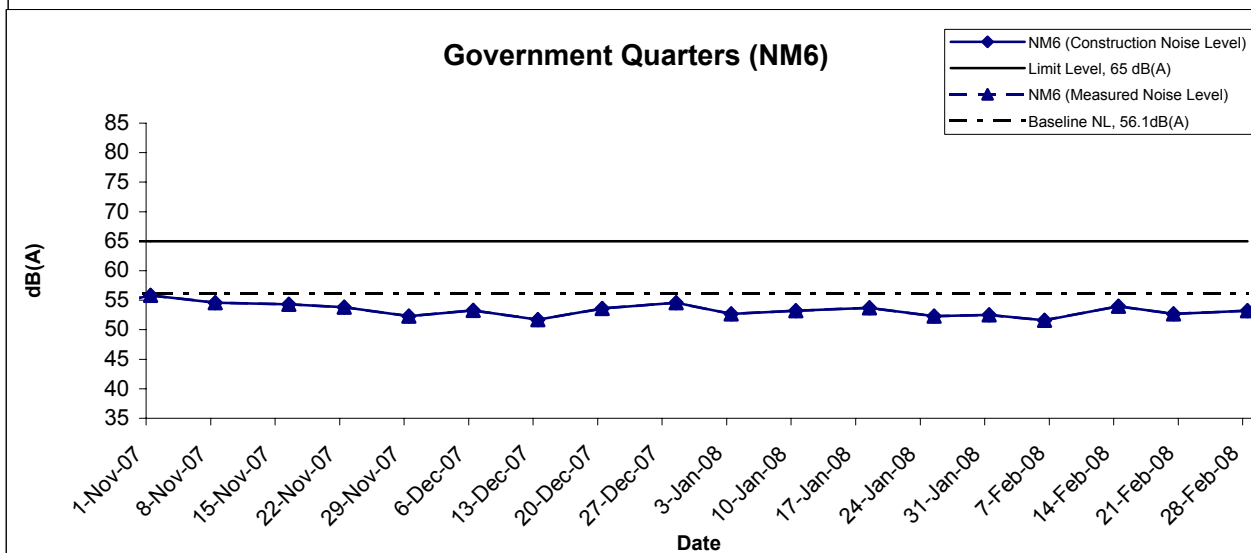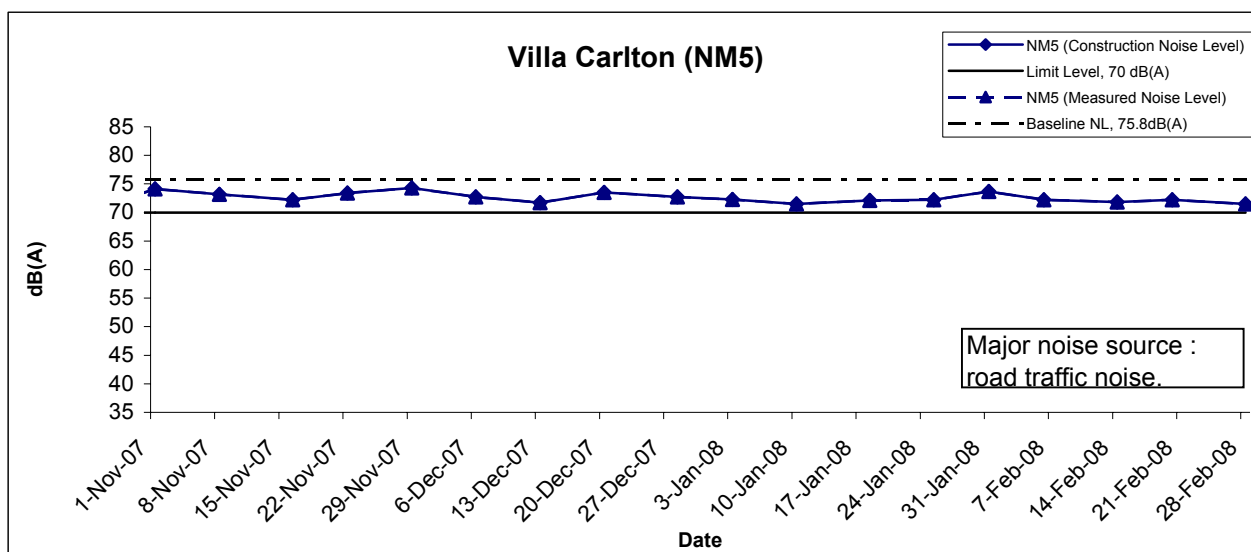

* Construction Noise Level = Measured Noise Level - Baseline Level
 (If the measured noise level is lower than the baseline level, the construction noise level will be taken as the measured one)

Title Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin Contract HY/2003/02 - Eagle's Nest Tunnel and Associated Works Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA3024	
	Date Feb 08	Appendix G	

Restricted Hours (23:00 to 07:00) - Noise Levels

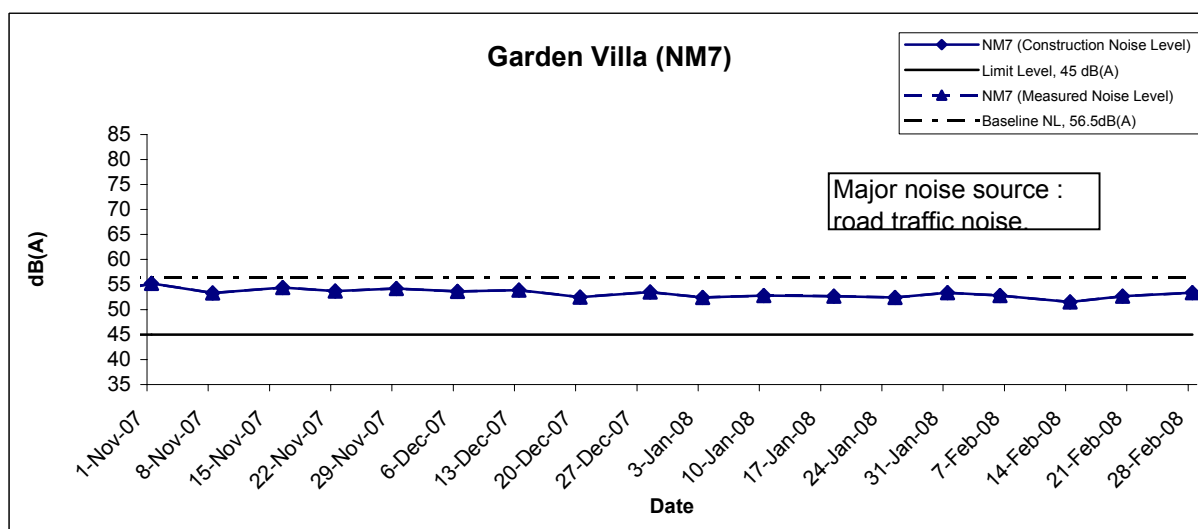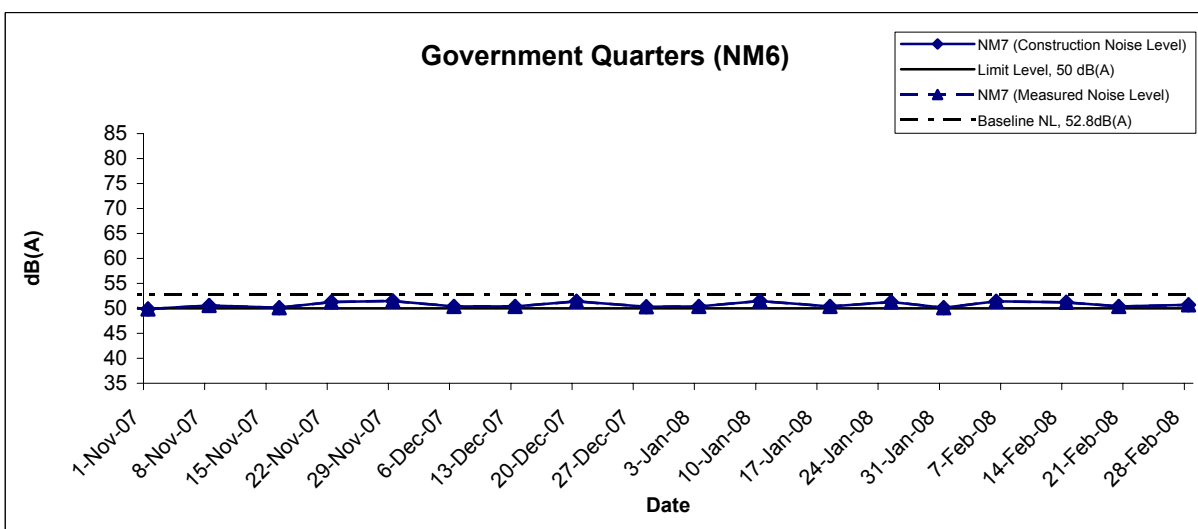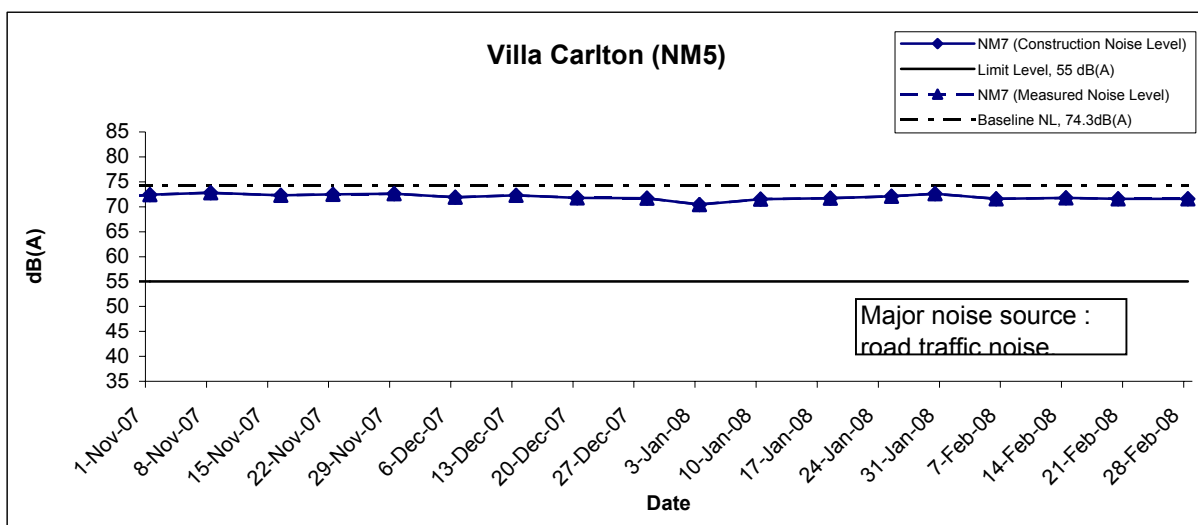

* Construction Noise Level = Measured Noise Level - Baseline Level
 (If the measured noise level is lower than the baseline level, the construction noise level will be taken as the measured one)

Title Route 8 (previously known as Route 9) between Cheung Sha Wan & Sha Tin Contract HY/2003/02 - Eagle's Nest Tunnel and Associated Works Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA3024	CINOTECH
	Date Feb 08	Appendix G	

APPENDIX H
SUMMARY OF EXCEEDANCE

Summary of Exceedances Recorded in the Reporting Month

a) Exceedance Report for 1-hr TSP: (NIL)

- No Action/Limit Level exceedance was recorded in the reporting month.

b) Exceedance Report for 24-hr TSP: (NIL)

- No Action/Limit Level exceedance was recorded in the reporting month.

c) Exceedance Report for Construction Noise: (NIL)

- No Action/Limit Level exceedance was recorded in the reporting month.

**APPENDIX I
SITE AUDIT SUMMARY**

**Route 8 (previously known as Route 9) between Cheung Sha Wan and Sha Tin
 Environmental Team for Lai Chi Kok Viaduct and Eagle's Nest Tunnel
 Contract No. HY/2003/02 – Eagle's Nest Tunnel and Associated Works**



Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	80204C-ENT
Date	4 February 2008 (Mon)
Time	10:30 – 11:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>A. Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>B. Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>C. Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>D. Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>E. Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>F. Others</p> <ul style="list-style-type: none"> Follow-up on previous audit (Ref. No.: 80130C-ENT), no environmental deficiency has been identified. Covering of loaded truck leaving the site was checked during the site inspection. No uncovered truck leaving the construction site was observed during the site inspection. 	

	Name	Signature	Date
Recorded by	Grace Wong		4 February 2008
Checked by	Dr. Priscilla Choy		4 February 2008

**Route 8 (previously known as Route 9) between Cheung Sha Wan and Sha Tin
 Environmental Team for Lai Chi Kok Viaduct and Eagle's Nest Tunnel
 Contract No. HY/2003/02 – Eagle's Nest Tunnel and Associated Works**



Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	80213C-ENT
Date	13 February 2008 (Wed)
Time	11:00 – 11:45

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>A. Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>B. Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>C. Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>D. Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>E. Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>F. Others</p> <ul style="list-style-type: none"> Follow-up on previous audit (Ref. No.: 80204C-ENT), no environmental deficiency has been identified. Covering of loaded truck leaving the site was checked during the site inspection. No uncovered truck leaving the construction site was observed during the site inspection. 	

	Name	Signature	Date
Recorded by	Grace Wong		13 February 2008
Checked by	Dr. Priscilla Choy		14 February 2008

Route 8 - Environmental Team for Lai Chi Kok Viaduct and Eagle's Nest Tunnel

Contract No. HY/2003/05 – Traffic Control and Surveillance System



Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	80213-ENT-TCSS
Date	13 February 2008 (Wednesday)
Time	10:40-10:50

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>A. Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>B. Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>C. Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>D. Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>E. Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>F. Others</p> <ul style="list-style-type: none"> Follow-up for previous audit session (Ref. No.: 80102-ENT-TCSS), no environmental deficiency was identified during the site inspection. 	

	Name	Signature	Date
Recorded by	Grace Wong		14 February 2008
Checked by	Dr. Priscilla Choy		14 February 2008

**Route 8 (previously known as Route 9) between Cheung Sha Wan and Sha Tin
 Environmental Team for Lai Chi Kok Viaduct and Eagle's Nest Tunnel
 Contract No. HY/2003/02 – Eagle's Nest Tunnel and Associated Works**



Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	80220-ENT
Date	20 February 2008 (Wed)
Time	13:30 – 14:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
001	<p>A. Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>B. Air Quality</p> <ul style="list-style-type: none"> Uncovered stockpile was observed near ENT South Portal Building. The Contractor was advised to cover it with tarpaulin. <p>C. Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>D. Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>E. Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>F. Others</p> <ul style="list-style-type: none"> Follow-up on previous audit (Ref. No.: 80213C-ENT), no environmental deficiency has been identified. Covering of loaded truck leaving the site was checked during the site inspection. No uncovered truck leaving the construction site was observed during the site inspection. 	C8

	Name	Signature	Date
Recorded by	Robert Tsang		20 February 2008
Checked by	Dr. Priscilla Choy		20 February 2008

**Route 8 (previously known as Route 9) between Cheung Sha Wan and Sha Tin
 Environmental Team for Lai Chi Kok Viaduct and Eagle's Nest Tunnel
 Contract No. HY/2003/02 – Eagle's Nest Tunnel and Associated Works**



Weekly Site Inspection Record Summary

Inspection Information

Checklist Reference Number	80227-ENT
Date	27 February 2008 (Wed)
Time	10:15 – 11:15

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>A. Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>B. Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>C. Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>D. Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>E. Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>F. Others</p> <ul style="list-style-type: none"> Follow-up on previous audit (Ref. No.: 80220-ENT), the environmental deficiency was rectified/improved by the Contractor. Covering of loaded trucks leaving the site was checked during the site inspection. No uncovered truck leaving the construction site was observed during the site inspection. 	

	Name	Signature	Date
Recorded by	Robert Tsang		27 February 2008
Checked by	Dr. Priscilla Choy		27 February 2008

APPENDIX J
EVENT ACTION PLANS

Appendix J - Event Action Plans

Event/Action Plan for Air Quality

EVENT	ACTION			
	ET	IEC	ER	Contractor
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source 2. Inform ER & IEC 3. Repeat measurement to confirm finding 4. Increase monitoring frequency to daily 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Check Contractor's working methods 	<ol style="list-style-type: none"> 1. Notify Contractor 2. Check monitoring data and Contractor's working methods 	<ol style="list-style-type: none"> 1. Rectify any unacceptable practice 2. Amend working methods if appropriate
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source 2. Inform ER & IEC 3. Repeat measurement to confirm findings 4. Increase monitoring frequency to daily 5. Discuss with ER & for remedial actions required 6. If exceedance continues, arrange meeting with ER & IEC 7. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Checking monitoring data submitted by ET 2. Check Contractor's working methods 3. Discuss with ET and Contractor on possible remedial measure 4. Advise the ER & ET on the effectiveness of the proposed remedial measures 5. Supervise the implementation of the remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Check Contractor's working methods 4. Discuss with ET, IEC and Contractor on proposed remedial actions 5. Ensure remedial actions properly implemented 	<ol style="list-style-type: none"> 1. Submit proposals for remedial actions to ER within 3 working days of notification 2. Implement the agreed proposals 3. Amend proposal if appropriate
LIMIT LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source 2. Inform ER & IEC and EPD 3. Repeat measurement to confirm finding 4. Increase monitoring frequency to daily 5. Assess effectiveness of Contractor's 	<ol style="list-style-type: none"> 1. Checking monitoring data submitted by ET 2. Check Contractor's working methods 3. Discuss with ET and Contractor on possible remedial measure 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Check Contractor's working methods 4. Discuss with ET, IEC and Contractor on 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to ER within 3 working days of notification

EVENT	ACTION			
	ET	IEC	ER	Contractor
	remedial actions and keep EPD and ER & IEC informed of the results	4. Advise the ER & ET on the effectiveness of the proposed remedial measures 5. Supervise the implementation of the remedial measures	proposed remedial actions 5. Ensure remedial actions properly implemented	3. Implement the agreed proposals 4. Amend proposal if appropriate
2. Exceedance for two or more consecutive samples	1. Identify source 2. Inform ER, IEC, Contractor and EPD the cause & actions taken for the exceedances 3. Repeat measurement to confirm findings 4. Increase monitoring frequency to daily 5. Investigate the causes of exceedance 6. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented. 7. Arrange meeting with EPD, IEC and ER to discuss the remedial actions to be taken 8. Assess effectiveness of Contractor's remedial actions and keep EPD and ER & IEC informed of the results 9. If exceedance stops, cease additional monitoring	1. Checking monitoring data submitted by ET 2. Discuss amongst ER, ET and Contractor on possible remedial measures 3. Review Contractor's remedial measures whenever necessary to ensure their effectiveness and advise the ER accordingly 4. Supervise the implementation of the remedial measures	1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented 4. Discuss amongst ET, IEC and the Contractor on proposed remedial actions 5. In consultation with IEC, agree with the contractor remedial measures to be implemented 6. Ensure remedial measure are properly implemented 7. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated	1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IEC, ER within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated

Event/Action Plan for Construction Noise

Exceedance	ACTION			
	ET	.IEC	ER	Contractor
Action Level	<p>1. Discuss with the IEC and ER and seek to identify potential noise source</p> <p>2. Undertake noise measurement to confirm the validity of complaint</p> <p>3. Inform ER&IEC in writing Discuss remedial actions required with ER&IEC if an exceedance is recorded</p> <p>4. Increase monitoring frequency to demonstrate efficacy of remedial measures</p> <p>5. If exceedance continues, meet with ER&IEC to review implementation of appropriate mitigation measures.</p> <p>6. If exceedance stops, cease additional monitoring</p>	<p>1. Review the analyzed results submitted by the ET</p> <p>2. Review the proposed remedial measures by the Contractor and advise the ER & ET accordingly</p> <p>3. Supervise the implementation of remedial measures</p>	<p>1. Confirm receipt of notification of complaint and notify Contractor immediately</p> <p>2. Check monitoring data trends and Contractor's working methods</p> <p>3. Remind the Contractor of his contractual obligations and discuss with ET, IEC and Contractor on proposed remedial actions</p> <p>4. Assess the efficacy of remedial actions and keep the Contractor informed</p> <p>5. Inform complainant of actions taken</p>	<p>1. Submit proposals for remedial actions to ER within three working days of notification</p> <p>2. Amend proposals if required by the Engineer</p> <p>3. Implement the remedial actions immediately upon instruction</p> <p>4. Liaise with the ER to optimize the effectiveness of the agreed mitigation</p> <p>5. Amend proposal if appropriate</p>

Exceedance	ACTION			
	ET	IEC	ER	Contractor
Limit Level	<ol style="list-style-type: none"> 1. Repeat measurement to confirm findings 2. Investigate the cause of the exceedance and identify the main source(s) of impact 3. Inform ER&IEC and EPD in writing 4. Discuss remedial actions required with ER&IEC 5. Increase monitoring frequency to demonstrate efficacy of remedial measures 6. Assess efficacy of remedial actions and keep ER & IEC informed of the results 7. If exceedance continues, meet with ER&IEC to identify appropriate mitigation measures 8. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Review Contractor's remedial actions to assure their effectiveness and advise the ER &ET accordingly 3. Supervise the implementation of the remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance and notify Contractor 2. Check monitoring data trends and Contractor's working methods 3. Discuss with ET, IEC and Contractor on proposed remedial actions to be implemented 4. Assess the efficacy of remedial actions and keep the Contractor informed 5. If exceedance continuous, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is aborted 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to ER immediately not more than 3 working days of notification 3. Amend proposals if required by the ER 4. Implement remedial actions immediately upon instruction 5. Liaise with the ER to optimize the effectiveness of the agreed mitigation 6. Resubmit proposals if problem still not under control 7. Stop the relevant portion of works as determined by the ER until the exceedance is aborted

**APPENDIX K
ENVIRONMENTAL MITIGATION
IMPLEMENTATION SCHEDULE (EMIS)**

Appendix K - Summary of Environmental Mitigation Implementation Schedule

Types of Impacts	Mitigation Measures	Status
Construction Dust	<ul style="list-style-type: none"> • Any stockpile of dusty materials or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water so as to maintain the entire surface wet. • A stockpile of dusty materials should not extend beyond the pedestrian barriers, fencing or traffic cones. • Vehicle washing facilities should be provided at every exit point. • The area where vehicle washing takes place and the section of the road between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores. • Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit. • Every main haul road should be sprayed with water or a dust suppression chemical so as to maintain the entire road surface wet. • The portion of any road leading only to a construction site that is within 30m of a discernible or designated vehicle entrance or exit should be kept clear of dusty materials. • Any stockpile of dusty materials should be either covered entirely by impervious sheeting, placed in an area sheltered on the top and the 3 sides or sprayed with water or a dust suppression chemical so as to maintain the entire surface wet. • All dusty materials should be sprayed with water or a dust suppression chemical immediately prior to any loading, unloading or transfer operation so as to maintain the dusty materials wet. • Every vehicle should be washed to remove any dusty materials from its body and wheels immediately before leaving a construction site. • The working area of any excavation should be sprayed with water or a dust suppression chemical immediately before, during and immediately after the operation so as to maintain the entire surface wet. 	<p>* ^ ^ ^ ^ * ^ ^ ^</p>
Construction Noise	<ul style="list-style-type: none"> • Only well-maintained plant should be operated on –site and plant should be serviced regularly during the construction works. • Machines and plant that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum. • Plant known to emit noise strongly in one direction, should where possible, be orientated to direct noise away from the NSRS. • Mobile plant should be sited as far away from NSRs as possible. • Material stockpiles and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. • Use quiet plant and Working Method • Reduce the number of plant operating in critical areas close NSRs. 	<p>^ ^ ^ ^ ^ ^ ^</p>

Types of Impacts	Mitigation Measures	Status
	<ul style="list-style-type: none"> Construct temporary and movable noise barriers 	^
Water Quality	<i>Construction Runoff and Drainage</i>	
	<ul style="list-style-type: none"> Use of sediment traps and the adequate maintenance of drainage systems to prevent flooding and overflow. 	^
	<ul style="list-style-type: none"> Boundaries of critical areas of earthworks should be marked and surrounded by dykes or embankments for flood protection. Temporary ditches should be provided to facilities runoff discharge into the appropriate watercourses, via a silt retention pond. Permanent drainage channels should incorporate sediment basins or traps and baffles to enhance deposition rates. 	^
	<ul style="list-style-type: none"> All temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge should be adequately designed for the controlled release of storm flows. All sediment traps should be regularly cleaned and maintained. The temporarily diverted drainage should be reinstated to its original condition when the construction works has finished or the temporary diversion is no longer required 	^
	<ul style="list-style-type: none"> Sand silt in the wash water from the wheel washing facilities, which ensure no earth, mud and debris is deposited on roads, should be settled out the removed before discharging into storm drains. A section of the road between the wheel washing bay and the public road should be paved with backfill to prevent wash water or other site runoff form entering public road drains. 	^
	<ul style="list-style-type: none"> Oil interceptors should be provided in the drainage system and regularly emptied to prevent the release of oils and grease into the storm water drainage system after accidental spillage. The interceptor should have a bypass to prevent flushing during periods of heavy rain. 	^
	<ul style="list-style-type: none"> Catchpits and perimeter channels shall be constructed in advance of site formation works and earthworks. 	^
	<ul style="list-style-type: none"> Silt removal facilities, channels and manholes shall be suitably maintained with the deposited silt and grit being removed at least once a week, and at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. 	^
	<ul style="list-style-type: none"> Earthworks final surfaces shall be well compacted and the subsequent permanent work or surface protection shall be carried out immediately after the final surfaces are formed to prevent erosion caused by rainstorms. Appropriate intercepting channels shall be provided along the site boundary or at the locations agreed with the ET Leader. Rainwater pumped out from trenches or foundation excavations shall be discharged into silt removal facilities before discharge into storm drains. 	^
	<ul style="list-style-type: none"> All generators, fuel and oil storage shall be within bunded areas. Drainage from the areas shall be connected to storm drains via a petrol interceptor. 	^
	<i>Tunnelling Work</i>	
	<ul style="list-style-type: none"> Temporary open storage of excavated materials should be covered with tarpaulin or similar fabric during rainstorms. Any washout of construction or excavated materials form the drill and blast tunnelling work should be diverted to the drainage system via appropriate sediment traps. 	^
	<ul style="list-style-type: none"> Ground water pumped out of tunnels should be discharged into the drainage channels which incorporated sediment traps to enhance deposition rates and to remove silt. 	^

Types of Impacts	Mitigation Measures	Status
	<ul style="list-style-type: none"> • Spent grouts used in diaphragm wall construction should be collected in a separate slurry collection system, reconditioned and reused wherever practicable. The disposal of used grouting materials will only be permitted if it is treated to the TM standards before discharge to the storm drains or disposal to landfill. 	N/A
	<i>General Construction Activities</i>	
	<ul style="list-style-type: none"> • Debris and rubbish on site should be collected, handled and disposed of properly to avoid entering the water column and cause water quality impacts. 	^
	<ul style="list-style-type: none"> • All fuel tanks and storage areas will be provided with locks and be located on sealed areas (within bunds of a capacity equal to 110% of the storage capacity of the largest tank or 20% by volume of the fuel stored in that areas, whichever in the greatest). 	^
	<i>Sewage Effluent</i>	
Waste	<ul style="list-style-type: none"> • Construction work force sewage discharges from fixed toilet facilities on-site should be connected to the nearby existing trunk sewer wherever feasible. However, for areas where existing trunk sewer is not available, it is recommended that appropriate and adequate on site portable chemical toilets should be provided by a licensed contractor who will be responsible for appropriate disposal and maintenance of these facilities. • It is considered that sewage discharges could also be treated by on-site septic tanks and soakaway. Minimum clearance away from streams and catchments and other requirements for the proposed septic tank and soakaway should be referred to EPD's Practice Note for Professional Persons, Drainage Plans. 	^ N/A
	<i>General</i>	
	<ul style="list-style-type: none"> • Training and instruction shall be given at a site to construction staff to increase awareness and draw attention to waste management issues and the need to minimise waste generation. The training requirement shall be included in the site waste management plan. 	^
	<i>Storage, Collection and Transportation of Waste</i>	
	<ul style="list-style-type: none"> • Wastes shall be handled and stored in a manner to ensure that they are held securely without loss or leakage. • Authorised or licensed waste hauliers shall be used and they shall only collect wastes prescribed by their permits. • Waste shall be removed on a daily basis. • Waste storage area shall be maintained and cleaned on a daily basis. • Windblown litter and dust during transportation shall be minimised by either covering trucks or transporting wastes in enclosed containers. • Obtain necessary waste disposal permits from the appropriate authorities if they are required. • Wastes shall be disposed of at licensed waste disposal facilities. • Develop procedure such as ticketing system to facilitate tracking of loads, particularly for chemical waste, and to ensure that illegal disposal of wastes does not occur. • Maintain records of the quantities of wastes generated, recycled and disposed. 	^ ^ ^ ^ ^ ^ ^ ^

Types of Impacts	Mitigation Measures	Status
	<i>Surplus Excavated Materials</i>	
	<ul style="list-style-type: none"> • Due to the high risk of loose material being washed into the existing nullah, stockpile materials should be properly compacted and covered from water erosion and located at least 10m away from the nullah wall. 	^
	<i>Construction and Demolition (C&D) Waste</i>	
	<ul style="list-style-type: none"> • Careful design, planning and good site management shall be adopted to minimise over-ordering and generation of waste materials such as concrete grouts. 	^
	<ul style="list-style-type: none"> • The handling and disposal of bentonite slurries shall be undertaken in accordance with Practice Note for Professional Persons – Construction Site Drainage (ProPECC PN 1/94) on construction site drainage. 	N/A
	<ul style="list-style-type: none"> • Construction and demolition (C&D) material shall be segregated to inert and non-inert parts. The inert portion shall re-used at areas of reclamation or land formation, or to public filling area shall such allocation is deemed necessary. The non-inert portion shall be disposed of to landfill. 	^
<i>Chemical Waste</i>		
<ul style="list-style-type: none"> • Chemical waste that is produce during construction shall be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes. 	^	
<ul style="list-style-type: none"> • Containers used for the storage of chemical wastes should: <ol style="list-style-type: none"> a. Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; 	^	
<ol style="list-style-type: none"> b. Have a capacity of less than 450 litres unless the specifications have been approved by the EPD; 		
<ol style="list-style-type: none"> c. Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Chemical Waste Regulations. 		
<ul style="list-style-type: none"> • The storage area for chemical wastes should: <ol style="list-style-type: none"> a. Be clearly labelled and used solely for the storage of chemical waste; 		
<ol style="list-style-type: none"> b. Be enclosed on at least 3 sides; 		
<ol style="list-style-type: none"> c. Have an impermeable floor and bunding of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in the area, whichever is largest; 	^	
<ol style="list-style-type: none"> d. Have adequate ventilation; 		
<ol style="list-style-type: none"> e. Be covered to prevent rainfall entering (water collected within the bund must be tested and disposed as chemical waste if necessary); 		
<ol style="list-style-type: none"> f. Be arranged so that incompatible materials are adequately separated. 		
<ul style="list-style-type: none"> • Disposal of chemical waste shall be via a licensed waste collector; and to a facility licensed to receive chemical waste; or a reuser of the waste (under approval from EPD). 	^	

Types of Impacts	Mitigation Measures	Status
	<p><i>General Refuse</i></p> <ul style="list-style-type: none"> General refuse generated on-site shall be stored in enclosed bins or compaction unit separate from C&D and chemical wastes. A reputable waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily for every second day basis to minimise odour, pest and litter impacts. The burning of refuse on construction sites is prohibited by law. Reusable rather than disposable dishware shall be used if feasible. 	<p>^</p> <p>^</p>
<p>Ecology</p>	<ul style="list-style-type: none"> A sediment barrier shall be erected to minimize stream sedimentation at downstream of the project boundary of the Toll Plaza. Conduct a tree survey before commencement of the construction work. All measures recommended in the approved landscape proposals under Condition 2.4 in EP above shall be fully implemented in accordance with the details and time schedule set out in the submission. Loss of the adjacent woodland due to temporary land take shall be returned to the original status immediately. Wild and uncontrolled fire shall be strictly prohibited Fences shall be erected along the boundary of the construction sites at the Toll Plaza before commencement of works, to prevent tipping, vehicle movements, and encroachment of personnel onto adjacent wooded areas. 	<p>N/A</p> <p>^</p> <p>N/A</p> <p>N/A</p> <p>^</p> <p>N/A</p>
<p>Landscape and Visual Impact</p>	<ul style="list-style-type: none"> Landscape mitigation measure 1 (LMM1) – Construction programming and management. The periphery of the works areas at street level shall be managed so that they do not appear cluttered, untidy and unattractive and inconvenient to pedestrians. For example, all hoarding shall be colorfully designed with interesting motifs demonstrating the work of Highways Department. Hoardings with bland colours shall be avoided. Landscape mitigation measure 2 (LMM2) – Advanced planting and erosion control works. Where possible, the transplantation of existing valuable trees, the stockpiling of topsoil, new planting and erosion control works shall be carried out as early as possible in the construction period instead of at the end. This will assist in maximizing the time for carrying out transplantation and new planting, resulting in a higher success rate for the survival of transplantation and new planting, resulting in a higher success rate for the survival of transplanted trees and the establishment of new screen trees. The stockpiling of topsoil will provide an abundant use of on-site material for growing media. During detailed design, the issue of stockpiling of topsoil in a manner that would avoid washing into the drainage scheme should be examined comprehensively. Measurement of vibration would also be carried out on a need basis during the piling work 	<p>^</p> <p>^</p> <p>^</p>


Remarks:

- | | | | |
|-----|-----------------------------------|---|--|
| ^ | Compliance of mitigation measure; | X | Non-compliance of mitigation measure; |
| N/A | Not Applicable; | • | Non-compliance but rectified by the contractor |

APPENDIX L
CONSTRUCTION PROGRAMME

Data Date 20FEB08
Run Date 25FEB08 08:50

3 MONTH ROLLING PROGRAMME

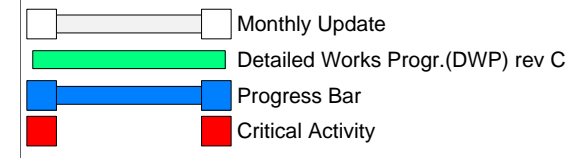

Act. ID	Activity Description	Orig Dur	Early Start	Early Finish	% Compl.	Target 1 % Comp	Rem Dur	Total Float	Variance Early Finish	DEC		JAN			FEB			MAR			APR			MAY			JUN							
										51	17	24	31	7	14	21	28	4	11	18	25	3	10	17	24	31	7	14	21	28	5	12	19	26
BUTTERFLY VALLEY																																		
Construction Works																																		
ROADWORKS - North End of BV																																		
Road Pavement & Associated Work																																		
S2920	Road Works to East Loop Rd Typ III (EVA)	13	15FEB07A	05FEB08A	100	0	0		-474	[Gantt bar: 15FEB07A to 05FEB08A, 100% complete]																								
S2900	Road Marking & White Lining (Staged for Access)	18	10DEC07A	14FEB08A	100	0	0		-364	[Gantt bar: 10DEC07A to 14FEB08A, 100% complete]																								
ROADWORKS - South End of BV																																		
Road Pavement & Associated Work																																		
S2990	Road Marking & White Lining (Staged Access)	18	10DEC07A	14FEB08A	100	0	0		-350	[Gantt bar: 10DEC07A to 14FEB08A, 100% complete]																								
DSD MAINTENANCE ROAD																																		
DSD Maintenance Rd DSD1 (Parallel to Channel)																																		
S2700	Access rd DSD1 -barrier footings	6	10SEP07A	26FEB08	90	0	6	-30	-482	[Gantt bar: 10SEP07A to 26FEB08, 90% complete]																								
S2720	Access rd DSD1 - Barriers	6	10SEP07A	26FEB08	90	0	6	-30	-470	[Gantt bar: 10SEP07A to 26FEB08, 90% complete]																								
S3160	REINSTATE BV ACCESS	0		22JAN08A	100	0	0		-361	[Milestone: 22JAN08A]																								
Landscaping & Establishment																																		
101476	BV - Soft Landscaping & Planting	100	03JUN06A	26FEB08	94	0	6	-30	-251	[Gantt bar: 03JUN06A to 26FEB08, 94% complete]																								
101477	BV - Establishment works	365	24NOV06A	24NOV08	0	0	279	-315	-219	[Gantt bar: 24NOV06A to 24NOV08, 0% complete]																								
101475	BV - Hard Landscaping	90	03JAN07A	26FEB08	90	0	6	-30	-417	[Gantt bar: 03JAN07A to 26FEB08, 90% complete]																								
ENT SOUTH PORTAL VENTILATION BUILDING																																		
CONSTRUCTION																																		
South Portal Bldg. - CIVIL & ABWF WORKS																																		
ABWF WORKS																																		
Roof & External Facade																																		
T2360	Ent SPB - GMS,S/S Roof Balustrade & Railing	24	24MAR07A	20FEB08A	100	0	0		-402	[Gantt bar: 24MAR07A to 20FEB08A, 100% complete]																								
T2390	Ent SPB - Expanded metal cladding to Ext Walls	18	08SEP07A	28FEB08	90	0	8	-32	-418	[Gantt bar: 08SEP07A to 28FEB08, 90% complete]																								
VENTILATION ADIT & BUILDING																																		
CONSTRUCTION WORKS																																		
EXTERNAL WORKS																																		
Road Pavement & Associated Work																																		
S1930	Signage, furniture and finishes	24	20JUL07A	03MAR08	90	0	11	-35	-345	[Gantt bar: 20JUL07A to 03MAR08, 90% complete]																								
VENTILATION BUILDING																																		
VA Building - ABWF																																		
VA Building - External Finishes																																		
T2110	VA Bldg. - Expanded metal cladding to Ext Walls	18	20OCT07A	11MAR08	85	0	18	-42	-442	[Gantt bar: 20OCT07A to 11MAR08, 85% complete]																								
T3100	VA Bldg. - Balustrades	11	10DEC07A	03MAR08	60	0	11	-35	-444	[Gantt bar: 10DEC07A to 03MAR08, 60% complete]																								
EXTERNAL AREAS																																		
LANDSCAPING & ESTABLISHMENT WORKS																																		
T3180	Planting Works	18	02SEP06A	26FEB08	95	0	6	-30	-412	[Gantt bar: 02SEP06A to 26FEB08, 95% complete]																								
T3200	Establishment Works	365	31OCT07A	24OCT08	0	0	248	-334	-391	[Gantt bar: 31OCT07A to 24OCT08, 0% complete]																								



© Primavera Systems, Inc.

LEIGHTON - KUMUGAI JV
R8 - EAGLES' NEST TUNNEL
CONTRACTORS TARGET PROGRAMME REV.1

Proj. Name: W40E
Layout: A4 3 MONTHS ROLLING PROGRAMME
Filter: 3 MONTH ROLLING PROGRAMME
Current Proj: W40E
Target 1 Proj: BE02
Sheet 1 of 2

LKJV/ENT/DWP/B			
Date	Revision	Checked	Approved
20FEB07	Prog update Feb 07	GW	RB

Act. ID	Activity Description	Orig Dur	Early Start	Early Finish	% Compl.	Target 1 % Comp	Rem Dur	Total Float	Variance Early Finish	DEC			JAN			FEB			MAR			APR			MAY			JUN						
										51	17	24	31	7	14	21	28	4	11	18	25	3	10	17	24	31	7	14	21	28	5	12	19	26
ENT NORTH PORTAL VENTILATION BUILDING																																		
CONSTRUCTION																																		
North Portal Bldg. - CIVIL & ABWF WORKS																																		
ABWF WORKS																																		
<small>NP Bldg - Roofing & External Facade</small>																																		
T1790	Ent NPB - GMS,S/S Channel, Balustrade & Railing	24	05MAR07A	13FEB08A	100	0	0			-434																								
T1770	Ent NPB - Expanded metal cladding to Ext Walls	18	12SEP07A	13FEB08A	100	0	0			-405																								
TOLL PLAZA & ANCILLIARY STRUCTURES																																		
Construction Works																																		
TOLL PLAZA WEST SIDE																																		
S1410	Furniture, signage (face only), white lining	18	06OCT07A	11FEB08A	100	0	0			-332																								
LANDSCAPING & ESTABLISHMENT WORKS																																		
S1480	Planting Works at Toll Plaza	24	10APR07A	26FEB08	80	0	6	-326		-267																								
S1490	Establishment Works at Toll Plaza	365	09OCT07A	09OCT08	0	0	226	-407		-196																								
ADMINISTRATION BUILDING																																		
CONSTRUCTION																																		
CIVIL & ABWF WORKS																																		
ABWF																																		
<small>Admin Bldg - Upper Roof & External Facade</small>																																		
T2340	AB Ext (GL 11-21) - Slate Replacement Cladding	30	03APR06A	02FEB08A	100	30	0			-502																								
T2330	AB Ext (GL 1-11) - Slate replacement Cladding	45	15OCT06A	02FEB08A	100	0	0			-457																								
T2900	AB Ext UR/LR - Insulation & Conc Roof Tile	30	06NOV06A	26FEB08	80	0	6	-30		-453																								
T2280	AB Ext (GL 11-16) - Expanded metal mesh cladding	18	13NOV07A	26FEB08	99	0	6	-30		-441																								
T2915	AB Ext UR/LR- Install GMS, Balustrades & Railing	18	13NOV07A	20FEB08A	100	0	0			-409																								
T2270	AB Ext (GL 3-11) - Expanded metal mesh cladding	18	03DEC07A	26FEB08	99	0	6	-30		-417																								
BUILDING SERVICES																																		
<small>Admin Bldg (Int. & Ext. Roof Lvl) - E & M Works</small>																																		
EM3600	BS Works in R/F	78	06JUN06A	22FEB08	98	1	3	-27		-461																								
SHATIN HEIGHTS SOUTH PORTAL BUILDING																																		
CONSTRUCTION																																		
CIVIL & ABWF WORKS																																		
ABWF																																		
<small>Roof & External Facade</small>																																		
AB6047	Sht SPB - GMS, S/S Channel, Balustrade & Railing	18	14AUG06A	13FEB08A	100	0	0			-446																								
AB6034	Sht SPB - Expanded metal cladding to ext walls	18	08OCT07A	13FEB08A	100	0	0			-424																								
SHT NORTH PORTAL BUILDING																																		
CONSTRUCTION																																		
CIVIL & ABWF WORKS																																		
ABWF Works																																		
<small>Roofing & External Facade</small>																																		
AB7250	Sht NPB - GMS, S/S Channel, Balustrade & Railing	18	16APR07A	13FEB08A	100	0	0			-425																								
AB7220	Sht NPB - Expanded metal cladding to Ext Walls	18	15OCT07A	13FEB08A	100	0	0			-424																								

Activity Description	Orig Dur	Early Start	Early Finish	% Comp	Total Float	2007												2008					
						O	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	O	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN
Installation @TD Wanchai TCC																							
Install Communication Devices@TD Wanchai TCC	4	20-02-08	23-02-08	0	-260													OGO2010					
Install Computer Equipment @TD Wanchai TCC	4	25-02-08	28-02-08	0	-261													OGO2020					
Install Remote Workstations @TD Wanchai TCC	5	25-02-08	29-02-08	0	-261													OGO2030					
Install CCTV system @TD Wanchai TCC	5	25-02-08	29-02-08	0	-256													OGO2040					
Installation @HyD ECC																							
Install Computer Equipment @HyD ECC	4	20-02-08	23-02-08	0	-260													OGO3010					
Install Remote Workstation @HyD ECC	4	20-02-08	23-02-08	0	-258													OGO3020					
Install Communication Devices@HyD ECC	4	20-02-08	23-02-08	0	-258													OGO3030					
Install CCTV system @HyD ECC	6	20-02-08	25-02-08	0	-258													OGO3040					
Installation @HKPF South Operational Base																							
Install Remote Workstation @HKPF South Base	4	20-02-08	23-02-08	0	-258													OGO5020					
Install Communication Devices@HKPF South Base	4	20-02-08	23-02-08	0	-258													OGO5030					
Install CCTV system @HKPF South Base	7	20-02-08	26-02-08	0	-258													OGO5040					
Installation @HKPF Tai Po RCCC																							
Install Computer Equipment @HKPF Tai Po RCCC	5	22-02-08	26-02-08	0	-258													OGO6010					
Install Remote Workstation @HKPF Tai Po RCCC	7	20-02-08	26-02-08	0	-256													OGO6020					
Install Communication Devices@HKPF Tai Po RCCC	6	20-02-08	25-02-08	0	-251													OGO6030					
Install CCTV system @HKPF Tai Po RCCC	4	20-02-08	23-02-08	0	-256													OGO6040					
Installation @HKPF West Kowloon (WK) RCCC																							
Install Remote Workstation @HKPF WK RCCC	6	25-02-08	01-03-08	0	-256													OGO7020					
Install CCTV system @HKPF WK RCCC	6	25-02-08	01-03-08	0	1,116													OGO7040					
Installation of SEC system for R8K & Portion B																							
Install SEC System (Stage 1 & 2) @Portion B	6	20-02-08*	25-02-08	0	75													B-1700					
Install SEC system in Existing & Early-Rtd @G	2	20-02-08	21-02-08	0	-277													G-6060					
Install & Demo. SEC System (Stage 1) @Portion G	5	01-03-08	05-03-08	0	-313													G-7080					
Install SEC System (Stage 2) @Portion G	5	06-03-08*	10-03-08	0	-290													G-7790					
Install SEC System (Stage 1) @Portion H1B	2	20-02-08*	21-02-08	0	-278													H1B1100					
Install SEC System (Stage 2) @Portion H1B	2	07-03-08*	08-03-08	0	-291													H1B1600					
Install SEC System (Stage 1) @Portion H1C	2	20-02-08*	21-02-08	0	-299													H1C1070					
Install SEC System (Stage 2) @Portion H1C	2	07-03-08*	08-03-08	0	-312													H1C1700					
Install SEC System (Stage 1) @Portion I2	5	01-03-08*	05-03-08	0	-289													I2-1040					
Install SEC System (Stage 2) @Portion I2	5	07-03-08	11-03-08	0	-291													I2-1750					
Install SEC System (Stage 1) @Portion J2	4	20-02-08*	23-02-08	0	-274													J-1100					
Install SEC System (Stage 2) @Portion J2	5	07-03-08*	11-03-08	0	-291													J-1700					
Install SEC Server & system (Stage 2) @R8K AB	8	20-02-08*	27-02-08	0	-274													KAB1180					
Installation for R8T																							
Portion B - Nam Wan Tunnel (NWT) Tubes																							
Installation @Portion B																							
Install CCTV System @Portion B	30	20-02-08	20-03-08	0	31													B-1090					
Install Manual fallback Control System @B	27	20-02-08	17-03-08	0	31													B-1200					
Install Emergency Telephone System @Portion B	34	03-03-07A	04-03-08	60	22													B-1300					
Portion C - Sections except Portion B @NWT&WTYY																							
Installation @Portion C (except WCB & TMCA)																							
Electrical Installation @Portion C	6	20-02-08	25-02-08	80	-14													C-1005					
Install ITRR System @Portion C (EPB,WPK)	12	10-05-08	21-05-08	0	-206													C-1010					
Install TCSS Equipment Cabinet @Portion C	13	20-02-08	03-03-08	60	34													C-1040					
Install SDH Node 1&3, Comm. Sys @C(WPK,EPB,Cabinet)	51	26-02-08	16-04-08	0	-12													C-1150					
Install Traffic Control Field Devices @Portion C	28	20-02-08	18-03-08	60	-1													C-1150					
Installation @West Control Building (WCB)																							
Install ITRR System @WCB	24	10-05-08	02-06-08	0	-175													WCB1050					
Install MFCP & its system @WCB	14	10-05-08	23-05-08	0	-175													WCB1080					
Install Oper. Facilities (Racks, Furniture) @WCB	35	20-02-08	25-03-08	0	-131													WCB1150					
Install SEC Server & system (Stage 2) @WCB	14	20-05-08	02-06-08	0	-41													WCB1650					
Portion D - Ngong Shuen Chau Viaduct (including VO103)																							
TTA in Existing Roads, WKH & Ramps E1&G @Portion D																							
Prepare & Submit TMCP to TMLG members, Portion D	25	20-02-08*	15-03-08	0	-243													TMPD01A					
Review & Comment TMCP by TMLG members, Portion D	14	16-03-08	29-03-08	0	-229													TMPD01AT					
Prepare & Resubmit TMCP to TMLG members, Portion D	25	30-03-08	23-04-08	0	-229													TMPD01BJ					
Accept TMCP by TMLG members, Portion D	14	08-05-08	21-05-08	0	-219													TMPD01BT					
Propose TIA, TTA measures in TMLG meeting, D	25	20-04-08	14-05-08	0	-229													TTAD02AJ					
Comment TIA, TTA measures by TMLG members, D	14	24-04-08	07-05-08	0	-229													TTAD02AT					
Prepare & Repropose TIA, TTA measures, Portion D	10	08-05-08	17-05-08	0	-229													TTAD02BJ					
Accept TIA, TTA measures by TMLG members, D	14	18-05-08	31-05-08	0	-229													TTAD02BT					
Installation @Portion D																							
Laying Backbone Cables @Portion D	24	18-05-07A	06-03-08	30	-109													D-8040					
Install Operation Facilities @Portion D (Kiosk F)	7	20-05-08	26-05-08	0	-185													D-8090					
Install SDH Node 4,5,6 & COMMUNICATION SYSTEM @D	23	20-02-08	13-03-08	0	-109													D-8100					
Install Traffic Control Field Devices @Portion D	36	04-04-07A	07-03-08	50	-106													D-8150					
Install CCTV System @Portion D	15	20-06-07A	26-02-08	50	-125													D-8250					
Install Vehicle Detector System @Portion D	29	20-02-08	19-03-08	0	-125													D-8270					
Install SEC System (Stage 1 & 2) @Portion D	8	20-05-08	27-05-08	0	-185													D-9300					
Portion E - East Tsing Yi Viaduct (ETVY)																							
Pre-Inspection of Civil Provisions @Portion E																							
Civil Provisions Inspection & Submit Report @E	7	20-02-08*	26-02-08	0	-14													E-0100					
Rectify Civil Provisions Defects by others @E	14	27-02-08	11-03-08	0	-14													E-0200					
Site Access of East Tsing Yi Viaduct (ETVY)	0	27-02-08*		0	0													E-0300					
Installation @Portion E																							
Install Cable Containment @Portion F	15	07-04-08	21-04-08	0	-30													E-1001					
Electrical Installation @Portion E	23	07-04-08	29-04-08	0	-19													E-1010					
Install TCSS Equipment Cabinet @Portion E	23	07-04-08	29-04-08	0	-30													E-1030					
Laying Backbone Cables @Portion E	26	07-04-08	02-05-08	0	-4													E-1050					
Install Traffic Control Field Devices @Portion E	47	05-05-08	20-06-08	0	-58													E-1200					
Install COMMUNICATION SYSTEM @Portion E	17	07-04-08	23-04-08	0	-4													E-1300					
Install CCTV System @Portion E	13	07-04-08	19-04-08	0	4													E-1500					
Install Vehicle Detector System @Portion E	30	21-04-08	20-05-08	0	-10													E-1600					

Activity Description	Orig Dur	Early Start	Early Finish	% Comp	Total Float	2007												2008																					
						O	2	29	5	NOV	12	19	26	3	10	17	24	31	7	14	21	28	4	11	18	25	3	MAR	10	17	24	31	7	14	21	28	5	12	19
System Acceptance Tests (SAT) @R8K																																							
SAT Procedure Document @R8K																																							
Prepare & Resubmit SAT Procedure for R8K	10	17-01-08A	26-01-08A	100		SAT8K1BJ																																	
Implement SAT @R8K																																							
Central System PointToPoint (Part1)	35	24-12-07A	27-01-08A	100		R8K2005																																	
SAT of MFC System @R8K	15	09-01-08A	23-01-08A	100		R8K2010																																	
SAT of CCTV System @R8K	15	08-01-08A	22-01-08A	100		R8K2030																																	
SAT of Traffic Control Devices @R8K	30	25-12-07A	23-01-08A	100		R8K2040																																	
SAT of Vehicle Detection System @R8K	15	09-01-08A	23-01-08A	100		R8K2050																																	
SAT of Electrical Installation @R8K	20	05-01-08A	24-01-08A	100		R8K2130																																	
Central System External Integation (Part2)	20	13-01-08A	01-02-08A	100		R8K2150																																	
Central System External Integation (Part3)	5	26-01-08A	30-01-08A	100		R8K2160																																	
SAT Result Document @R8K																																							
Submit & Approve SAT Result of Central System@R8K	14	17-01-08A	30-01-08A	100		R8K4005																																	
Submit & Approve SAT Result of MFC System @R8K	14	24-01-08A	06-02-08A	100		R8K4010																																	
Submit & Approve SAT Result of Comm.Sys. @R8K	14	09-01-08A	22-01-08A	100		R8K4020																																	
Submit & Approve SAT Result of CCTV System @R8K	14	18-01-08A	31-01-08A	100		R8K4030																																	
Submit & Approve SAT Result of TCD @R8K	14	24-01-08A	06-02-08A	100		R8K4040																																	
Submit & Approve SAT Result of VDS @R8K	14	24-01-08A	06-02-08A	100		R8K4050																																	
Submit & Approve SAT Result of PBX System @R8K	14	19-01-08A	01-02-08A	100		R8K4060																																	
Submit & Approve of Tunnel Radio Sys. @R8K	14	19-01-08A	01-02-08A	100		R8K4070																																	
Submit & Approve SAT Result of O&M Radio Sys.@R8K	14	19-01-08A	01-02-08A	100		R8K4080																																	
Submit & Approve SAT Result of ET System @R8K	14	09-01-08A	22-01-08A	100		R8K4090																																	
Submit & Approve SAT Result of PA System @R8K	14	19-01-08A	01-02-08A	100		R8K4100																																	
Submit & Approve SAT Result of Oper.Facilities@R8K	14	09-01-08A	22-01-08A	100		R8K4110																																	
Submit & Approve SAT Result of Elect.Install.@R8K	14	25-01-08A	07-02-08A	100		R8K4130																																	
Implement Interface Test with Others @R8K																																							
Interface Test with ENT Contractor for CMCS	5	26-01-08A	30-01-08A	100		ITR8K001																																	
Interface Test with HKPF, HyD, TD & FSD	3	28-01-08A	30-01-08A	100		ITR8K002																																	
Interface Test with R8K Toll System	3	28-01-08A	30-01-08A	100		ITR8K003																																	
System Acceptance Tests @R8 (with EOT)																																							
SAT Procedure Document @R8T																																							
Prepare & Submit SAT Procedure for R8T	14	16-05-08*	29-05-08	0	-76	SAT8T1AJ																																	
Operability Test (OPT) @R8K																																							
Implement Operability Test @ R8K	30	20-02-08	20-03-08	0	-287	R8K2500																																	
Submit & Approve OPT Report @R8K	10	11-03-08	20-03-08	0	-268	R8K2510																																	
Repeat SAT of VDS & Calibrate if required @R8K	12	09-03-08	20-03-08	0	-277	R8K2900																																	
Submit & Approve re-SAT Result of VDS @R8K	7	14-03-08	20-03-08	0	-277	R8K4140																																	
SAT & OPT for SEC system @R8K																																							
SAT of SEC System @R8K	20	30-03-08	18-04-08	0	-311	R8K2120																																	
Submit & Approve SAT Result of SEC System @R8K	14	19-04-08	02-05-08	0	-311	R8K2300																																	
Implement Operability Test of SEC system @R8K	30	03-05-08	01-06-08	0	-245	R8K2800																																	
Submit & Approve OPT Report of SEC system @R8K	14	19-05-08	01-06-08	0	-245	R8K2810																																	
Operation and Maintenance Documents & Training																																							
Documentation for R8K Opening																																							
System Description for R8																																							
Accept System description by Engineer	28	01-03-08	28-03-08	0	-213	R8K301BT																																	
Operation Manual for R8K																																							
Accept Operation Manual by Engineer	28	25-02-08	23-03-08	0	-208	R8K302BT																																	
System Administration Manual for R8K																																							
Accept System Administration Manual by Engineer	28	25-02-08	23-03-08	0	-208	R8K303BT																																	
Maintenance Plan for R8																																							
Prepare&SubmitDraftMaintenancePlan for R8K & R8T	14	20-02-08	04-03-08	0	-433	R8314AJ																																	
Review Maintenance Plan for R8K&R8T by Engineer	28	05-03-08	01-04-08	0	-277	R8314AT																																	
Prepare&Re-submitMaintenancePlan for R8K&R8T	10	02-04-08	11-04-08	0	-277	R8314BJ																																	
Accept Maintenance Plan for R8K&R8T	28	12-04-08	09-05-08	0	-255	R8314BT																																	
Maintenance & Services Manual for R8K																																							
Prepare Spares & Maintenance Tools List for R8K	14	02-04-08	15-04-08	0	-277	GEN009AJ																																	
Prepare & Submit Maintenance Manual for R8K	14	07-04-08	20-04-08	0	-277	R8K304AJ																																	
Review Maintenance Manual for R8K by Engineer	28	16-04-08	13-05-08	0	-277	R8K304AT																																	
Prepare & Re-submit Maintenance Manual for R8K	10	09-05-08	18-05-08	0	-277	R8K304BJ																																	
Accept Maintenance Manual for R8K by Engineer	28	04-05-08	31-05-08	0	-277	R8K304BT																																	
Training Plan for R8K																																							
Accept Training Plan for R8K by Engineer	28	01-03-08	28-03-08	0	0	GEN008BT																																	
Training Material for R8K																																							
Prepare&Submit Training Material	21	29-03-08	18-04-08	0	0	R8K305AJ																																	
Review Training Material for R8K by Engineer	28	19-04-08	16-05-08	0	0	R8K305AT																																	
Prepare&Re-submit Training Material	10	17-05-08	26-05-08	0	0	R8K305BJ																																	
Documentation for R8 Opening																																							
Revised Operation Manual for R8																																							
Prepare&Submit Operation Manual for R8T	14	25-02-08*	09-03-08	0	-148	R8T307AJ																																	
Review Operation Manual for R8T by Engineer	28	10-03-08	06-04-08	0	-148	R8T307AT																																	
Prepare&Re-submit Operation Manual for R8T	10	07-04-08	16-04-08	0	-148	R8T307BJ																																	
Accept Operation Manual for R8T by Engineer	28	17-04-08	14-05-08	0	-148	R8T307BT																																	
Revised System Administration Manual for R8																																							
Prepare&Submit System Administration Manual, R8T	14	15-05-08	14-05-08	0	-148	R8T308AJ																																	
Review System Administration Manual R8T by Eng'r	28	15-05-08	14-05-08	0	-148	R8T308AT																																	
Prepare&Re-submit System Administration Manual	10	15-05-08	24-05-08	0	-148	R8T308BJ																																	
Training Plan for R8T Opening																																							
Prepare&Submit Training Plan for R8	14	20-02-08*	04-03-08	0	-41	R8K309AJ																																	
Review Training Plan for R8 by Engineer	28	05-03-08	01-04-08	0	-41	R8K309AT																																	
Prepare&Resubmit Training Plan for R8	10	02-04-08	11-04-08	0	-41	R8K309BJ																																	
Accept Training Plan for R8 by Engineer	28	12-04-08	09-05-08	0	-41	R8K309BT																																	

**APPENDIX M
COMPLAINT LOG**

Appendix M - Complaint Log

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
40426	Butterfly Valley	26 April 2004	<p>A public noise complaint was recently received by EPD. The complaint was related to the noise generated from the Route 8 – ENT site near Butterfly Valley at the night time on 21 April 2004. EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 23 April 2004.</p>	<p><u>Noise at night time</u> The information provided by the RSS indicated that no works were undertaken by the Contractor during the concerned period. The concerned noise might probably be due to a burglary case occurred at same night.</p> <p><u>Noise during day-time</u> It is believed that the day-time noise complaint was due to the site formation works of the Project. Considering the powered mechanical equipment used at the Butterfly Valley and the echo effect of the valley, ET believe that the day-time construction noise from the site at Butterfly Valley might cause nuisance to the nearby resident to some extent, though there was no noise level exceedance at the Government Quarters during our routine monitoring in last three months.</p> <p>The Contractor agreed to implement mitigation measures, including good site practices, selecting quieter plant and working methods and reduction in numbers of noisy plant operating currently, in order to mitigate noise impacts at the NSRs.</p>	Closed
40914	Garden Villa	<p>13-Sep-04 (by EPD)</p> <p>14-Sep-04 (by ET Leader)</p>	<p>Environmental Protection Department (EPD) received a public noise complaint on 13 September 2004 about construction noise generated from the Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project, nearby by Garden Villa at Tai Po Road, Sha Tin. EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 14 September 2004.</p> <p>The complaint was about general construction noise generated from a construction site nearby Garden Villa at Tai Po Road, Sha Tin. As informed by EPD,</p>	<p><u>Environmental Permits</u> A Construction Noise Permit (No. GW-RN0405-04) was obtained by the Contractor for the use of powered mechanical equipment (PME) in the concerned works area and use of TAR no.1 during restricted hours.</p> <p><u>Blasting Works</u> According to the information provided by the Resident Site Staff (RSS), for carrying out blasting works, a blasting permit should be issued by the Mines Division of Civil Engineering and Development Department (CEDD), but not under the jurisdiction of EPD. The CNP issued by EPD only specified the use of PME but not the blasting works during restricted hours.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			<p>the complainant was particularly concerned of two issues:</p> <ol style="list-style-type: none"> 1. The complainant was informed by the Contractor (Leighton – Kumagai Joint Venture) that blasting works would be conducted during restricted hours. He worried about the noise nuisance would be induced by the blasting works. 2. Noise nuisance from some site vehicles traveling on the Temporary Access Road (TAR no.1) near Garden Villa was noted by the complainant during restricted hours. 	<p>As advised by the RSS, the Contractor did intend to apply for a permit to the Mines Division of CEDD for blasting works during restricted hours. However, up to the time of preparation of this report, the Contractor still had not obtained the approval from the Mines Division and therefore, no blasting works were performed by the Contractor during restricted hours.</p> <p><u>Use of TAR no.1</u> According to Condition 3d of the above-mentioned CNP, there was restriction on the use of site vehicles traveling on TAR no.1.</p> <p>The usage of site vehicles on TAR no.1 in a 2-week period before the date of complaint, i.e. 30th August to 12th September 2004 showed that the only vehicle type using TAR no.1 for the concerned period was concrete truck and the number of vehicle pass was limited to 4 times per hour, which was in compliance with the above CNP's conditions.</p> <p>Regular noise monitoring was undertaken by ET at Garden Villa on 30th August and 6th September 2004 during restricted hours (1900 – 2300 hours). The monitoring results were 58.7 dB(A) and 58.6 dB(A), respectively, which were below the noise limit level of 60 dB(A). However, it should be noted that site vehicles were not used by the Contractor on TAR no.1 during restricted hours on these two monitoring day.</p> <p>Based on the information obtained, the validity for the noise complaint in associated with night-time blasting works could not be concluded under ET's investigation, since no blasting works had been performed by the Contractor during restricted hours at the time of the report preparation. Also, it should be highlighted that for carrying out blasting works, permission should be obtained by Mines Division of CEDD, but not under the control of EPD.</p> <p>For the use of TAR no.1, the RSS's records showed that the number of vehicle pass in the period between 30th August and 12th September 2004 was complied with the CNP's conditions. It should be noted that only a maximum of 3 concrete trucks</p>	

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>passing the site entrance was recorded. Therefore, it was considered that the nuisance noted by the complainant was not due to the site vehicles adopted by the Contractor (LKJV).</p> <p>Nevertheless, the Contractor was reminded to ensure the compliance of the CNP conditions and adopt good site practice to minimize the construction noise.</p>	
41021	Garden Villa	<p>09-Oct-04 (by EPD)</p> <p>21-Oct-04 (by ET Leader)</p>	<p>Environmental Protection Department (EPD) received a public noise complaint on 9 October 2004 about construction noise generated from the Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project, nearby by Garden Villa at Tai Po Road, Sha Tin. EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 21 October 2004.</p> <p>The complaint was about nighttime construction noise generated from a construction site nearby Garden Villa at Tai Po Road, Sha Tin. As informed by EPD, the complainant was particularly concerned of two issues:</p> <ul style="list-style-type: none"> • Construction works undertaken by the Contractor (Leighton–Kumagai Joint Venture) were noted after 2300 hour. • Some workers were noted leaving the site through Temporary Access Road (TAR) no.1 at around 2 am, causing nuisance to the residents in Garden Villa. 	<p>According to the information provided by the RSS, no construction activity was undertaken in the nighttime period (2300 – 0700 hours) at the concerned site area.</p> <p>LKJV did admit that some vehicles had been operating at midnight for transporting LKJV’s survey workers from the site. Inconsiderate behaviors were noted causing nuisance to Garden Villa residents:</p> <ol style="list-style-type: none"> 1. Driving the vehicles too fast, which generated excessive engine noise; 2. Noise inside the vehicles (such as staff talking or radios) escaping through the open vehicle windows; and 3. Vehicle beeping horn to request the guards to open the gate. <p>In order to rectify the situation, LKJV had notified the relevant staff with the receipt of the complaint and urged them to take appropriate measures when using TAR1 at night:</p> <ol style="list-style-type: none"> 1. to drive slowly in order to reduce the engine noise, especially when approaching Garden Villa; 2. to roll up the vehicle windows to contain any noise from talking or radios; and 3. to prohibit beeping the vehicle horn for gate opening; instead, to park the car and approach the guard on foot. 	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
41023	Government Quarters (Butterfly Valley)	20-Oct-04 (by MHJV) 23-Oct-04 (by ET Leader)	A public complaint was received by the Engineer's Representative (ER) of Route 8 – Eagle's Nest Tunnel and Associated Works (R8-ENT) Project on 20 th October 2004. The complaint was raised by a resident of the Government Quarters at Caldecott Road, concerning dust generation as a result of the construction activities at Butterfly Valley. The ER subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 23 rd October 2004.	<p>The complaint was considered valid based on:</p> <ol style="list-style-type: none"> 1. ER's site observations; 2. ET's weekly site audit; and 3. 1-hr TSP exceedance record. <p>Also, the sources of dust generation were identified as</p> <ol style="list-style-type: none"> 1. 2 portions of the haul roads, one at Slope BV-S2 and one linking between South Portal Tunnel to Mui Kong Tsuen, were found to be dry. 2. Dust impact due to the haulage of excavated materials at the South Portal. <p>Enhanced dust suppression measures had been implemented by the Contractor:</p> <ul style="list-style-type: none"> • added rockfill to the haul road between South Portal Tunnel and the Gully fill area; • maintained watering to haul road at Slope BV-S2; • requested the fill material supplier to ensure the material was in a damp condition before leaving quarry; • provided for material not dampened at the Quarry to be directed to the wheel wash for water spray before entering the site; • when cleaning drill holes along slope BV-S4 to ensure adequate water was available for flushing to suppress dust emission; AND • provided damper stockpiles of cleared material at BV-S2 before loading. <p>Based on ER's site observations, most of the above mitigation measures have been implementing by the Contractor. Also, an additional water browser was delivered to site on 29th Oct 04. No significant fugitive dust emission has been found.</p> <p>During ET's site inspections on 27th Oct and 3rd Nov 2004, the situation was found improved. No deficiency relating to air quality impact was noted by ET during the two audit sessions.</p> <p>The results of air quality monitoring (1-hr and 24-hr TSP) in the period between 21st Oct and 2nd Nov 2004 were all found to be complied with the Action / Limit Levels.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
41124	Government Quarters (Butterfly Valley)	21-Nov-04 (by LKJV) 24-Nov-04 (by ET Leader)	A public complaint was received by the Contractor of Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project on 21 st November 2004 (Sunday). The complaint was concerned about excessive noise generation from construction machinery at Butterfly Valley on the same day. The Engineer’s Representative (ER) subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 24 th November 2004.	According to the ER, the only construction activity at Butterfly Valley undertaken on 21 st Nov 04 was formation of access road near Slope BV-S2. The activity only involved operations of 1 no. of excavator and 1 no. of dump truck with grab, which complied with the condition stipulated in a valid CNP GW-RW0484-04, which was hold by the Contractor. Routine noise monitoring was conducted on 21 st and 28 th Nov 2004 at NM6. All the measured noise levels (48.5 to 56.4 dB(A)) were well below the noise limit level. In addition, the measurement results were within the baseline noise level. Therefore, the complaint was considered to be invalid. Nevertheless, the Contractor was reminded to ensure the compliance of the conditions stipulated in CNP. The Contractor was also recommended to adopt good site practice in order to minimize the construction noise.	Closed
41201	Government Quarters (Butterfly Valley)	01-Dec-04 (by MHJV & ET Leader)	A public complaint was received by the Engineer’s Representative (ER) of Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project on 1 st December 2004. The complaint was raised by a resident of the Government Quarters at Caldecott Road, concerning dust generation at Butterfly Valley. The Environmental Team (ET) of the Project was informed with the complaint on the same day. The resident complained that a large portion of the excavated slopes was not properly covered, which caused dust nuisance to her.	The complaint was considered valid based on: 1. ER’s site observations; 2. ET’s weekly site audit Upon receipt of the complaint, a series dust control measures had been implemented by the Contractor, such as covering of the exposed slopes with appropriate sheeting, regular watering to the haul roads and excavated slope faces, etc. During the ET’s weekly site audit on 08-Dec-04 together with the representative of HyD, IEC, ER and the Contractor, the above mitigation measures were observed. The idle slopes at BVS2 had been covered by tarpaulin sheeting and erosion mat. The left exposed slope surfaces at BVS2 were under excavation, thus being unable to be covered. According to the ER, the complainant has expressed his satisfaction to the site condition on 07-Dec-04, after the implementation of dust mitigation measures by the	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>Contractor.</p> <p>However, owing to the prevailing of the dry season, the Contractor was reminded to ensure the dust control measures are effectively implemented.</p>	
50125	Garden Villa (North Portal)	<p>21-Jan-05 (by EPD)</p> <p>25-Jan-05 (by ET Leader)</p>	<p>Environmental Protection Department (EPD) received a public noise complaint on 21 January 2005 about construction noise and dust generated from the Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project, nearby by Garden Villa at Tai Po Road, Sha Tin. EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 25 January 2005.</p> <p>The complaint was about construction noise and dust generated from a construction site nearby Garden Villa at Tai Po Road, Sha Tin. The complainant was particularly concerned of two issues:</p> <ol style="list-style-type: none"> 1. Noise from tunnel blasting work carrying out at around 7:30am and 10:00pm; and 2. Dump trucks without covering of canvas when leaving the construction site. 	<p>Noise from blasting For carrying out the blasting, the Contractor had obtained the permit from relevant authority. The ET’s noise monitoring results did not show any exceedance for the measurement taken when blasting was in place. It should be highlighted that for carrying out blasting works, permission should be obtained by Mines Division of CEDD, but not under the control of EPD. In order to minimize the nuisance from the works, the Contractor was recommended:</p> <ul style="list-style-type: none"> • To inform the residents around the area about the time of blasting in advance; and • To re-schedule the blasting time table, if possible, in order to avoid nuisance. <p>Uncovered dump trucks In order to evaluate the situation, two inspections were carried out by the ET at Garden Villa on 27-Jan and 28-Jan-05 to identify the dump trucks leaving the site with uncovered load. On 27-Jan-05, 3 nos. of trucks, which were working for ENT Project, was noted by-passing Garden Villa without proper cover.</p> <p>Enhanced control (penalty system) was implemented by the Contractor after the inspection on 27-Jan. During the inspection on 28-Jan-05, 24 nos. of dump trucks for ENT Project were found leaving the site. No non-compliance was noted for the trucks working for ENT Project.</p> <p>LKJV was reminded to keep closely monitoring on the condition and the effectiveness of the proposed control measures.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50308	Garden Villa (North Portal)	05-Mar-05 (by EPD) 08-Mar-05 (by ET Leader)	<p>EPD received a public complaint on 5 March 2005 about construction noise and dust generated from the construction sites of Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) and Route 8 - Sha Tin Heights Tunnel and Approaches (R8-SHT), nearby by Garden Villa at Tai Po Road, Sha Tin. EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 8 March 2005.</p> <p>The complaint was about construction noise and dust generated from the construction sites nearby Garden Villa at Tai Po Road, Sha Tin. The complainant was particularly concerned of the following issues:</p> <ol style="list-style-type: none"> 1. Nighttime & Sunday construction noise 2. Noise from tunnel blasting at early morning and nighttime 3. Dust from construction activities 	<p><i>Nighttime & Sunday construction noise</i></p> <ul style="list-style-type: none"> • no exceedance for noise monitoring • restricted hour works were found complied with the CNPs • records of vehicular trips on TAR1 did not show non-compliance of CNP conditions <p><i>Noise from tunnel blasting at early morning and nighttime</i></p> <ul style="list-style-type: none"> • no exceedance for noise monitoring • valid blasting permit had been obtained from CEDD • blasting work is not under the jurisdiction of EPD <p><i>Dust from construction activities</i></p> <ul style="list-style-type: none"> • dump trucks with uncovered / inadequately covered materials were observed leaving site • no exceedance for TSP monitoring • enhanced dust suppression measures had been implemented by the Contractor <p><u>Conclusions</u> The complaint against the dust issue (uncovered / inadequately covered dump trucks) was considered justifiable. The Contractor was reminded to review the current checking system. Continuous spot checks would be performed by ET and RSS.</p>	Closed
50330	Garden Villa (TAR1)	30-Mar-05 (by EPD & ET Leader)	<p>Environmental Protection Department (EPD) received a public complaint on 30th March 2005 about construction noise from the sites of Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) near Garden Villa at Tai Po Road, Sha Tin.</p> <p>The complaint, which was lodged by a resident of Garden Villa on 29th March 2005, was about the noise generated by heavy vehicles traveling in and out of the construction site near Garden Villa. According to the complaint, the noise was made from 7am onwards.</p>	<p>The site of concern was likely to be the Temporary Access Road no.1 (TAR1) connecting Tai Po Road and the construction sites of R8-ENT and Route 8 - Sha Tin Heights Tunnel and Approaches (R8-SHT).</p> <p>The time period of concern was within normal working hours (7am to 7pm) on a weekday not being holidays. According to the EM&A Manual, the criterion of construction noise in term of $L_{eq-30min}$ within this period is 75 dB(A) for domestic premises.</p> <p>Since the commencement of the Project, no exceedance of daytime noise criterion of 75 dB(A) was recorded at Station AM3 (Garden Villa). During the 2-hour measurement period of the ad-hoc monitoring (0700-0900 hrs), all the measured noise levels ($L_{eq-30min}$) were below the daytime noise</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>criterion of 75 dB(A).</p> <p>Based on the results of routine noise monitoring and the ad-hoc measurement on 1st April 2005 at Garden Villa, no exceedance of daytime noise criterion of 75 dB(A) was recorded. The complaint lodged is therefore considered not justifiable.</p> <p>In order to minimize the nuisance generated by the vehicle use at Garden Villa, the Contractor has proposed to limit the frequency of trucks existing from TAR1 at a rate of one truck per minute during the time period of concern (7am to 8:30am).</p>	
50415	Government Quarters	<p>09-Apr-05 (by EPD)</p> <p>15-Apr-05 (by ET Leader)</p>	<p>The complaint, which was lodged by a resident of 7/F, 38B, 8-10 Caldecott Road (Governmental Quarters) on 9th April 2005, was about the noise generated by the construction works at the Butterfly Valley during daytime. The complainant mentioned that the instant noise level taken by himself was 78 to 82 dB(A).</p> <p>EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 15th April 2005.</p> <p>The time period of concern was within normal working hours (7am to 7pm) on a weekday not being public holidays. According to the EM&A Manual, the criterion of construction noise in term of L_{eq}-30min within this period is 75 dB(A) for domestic premises.</p>	<p>Governmental Quarters (Station NM6) is one of the designated noise monitoring stations in the EM&A programme. Routine monitoring is undertaken on a weekly basis in accordance with the EM&A Manual.</p> <p>Since the commencement of the Project, no exceedance of daytime noise criterion of 75 dB(A) was recorded at this station.</p> <p>Ad-hoc measurement was conducted at the complainant's premises on 22 Apr 05. The measured noise level was 69.0 dB(A), which was well below the daytime noise criterion of 75 dB(A).</p> <p>Based on the results of routine noise monitoring and the ad-hoc measurements conducted in the complainant premises, no exceedance of daytime noise criterion of 75 dB(A) was recorded. The complaint lodged is therefore considered not justifiable.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50419	Government Quarters	<p>15-Apr-05 (by EPD)</p> <p>19-Apr-05 (by ET Leader)</p>	<p>The complaint was lodged by a resident of 8-10 Caldecott Road (Government Quarters) on 15th April 2005 to EPD as well as the Chief Resident Engineer of the Project.</p> <p>EPD subsequently referred the complaint to the Environmental Team (ET) Leader of the Project on 19th April 2005.</p> <p>The complainant mentioned that they had experienced quite a lot of noise emanating from the tunnel drilling area after 11pm over several nights and most particularly at the night of 14th April 2005 and at 4am on 15th April 2005.</p>	<p>The site of concern was likely to be the South Portal. For carrying out construction works at this area during restricted hours, two Construction Noise Permits (CNPs no. GW-RW0085-05 and GW-RW0086-06) were obtained by the Contractor in accordance with the requirements stipulated in Noise Control Ordinance.</p> <p>According to the information provided by the Resident Site Staff and the Contractor, the construction activities undertaken in the period between 11th and 15th April 2005 from 1900 to 0700 hours included drilling, breaking, trimming, set up of rock drill, installation of arch-rib and grouting.</p> <p>The powered mechanical equipment (PME) involved in the above works included backhoe, rock drill, loader, dumper, shot-crete machine, group pump, mobile platform and grout machine, which were covered by the CNPs.</p> <p>According to the routine monitoring results, for the time period between 2300-0700 hours, the measured noise levels exceeded the corresponding noise Limit Level of 50dB(A). However, the measured levels were found within the range of baseline level and below the average baseline level.</p> <p>Based on the routine noise monitoring results at Station NM6, the measured noise levels for the period between 2300-0700 hours were below the baseline noise level, which was comparable to the ambient level. According to the RSS's record, the PME items operated during the concerned period were found covered by the 2 CNPs hold by the Contractor.</p> <p>Based on the available information, there is not enough evidence to prove whether the complaint against nighttime construction noise generated in the concerned period (11th to 15th April 2005) is justifiable or not.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50512	Yew Chung International School	12-May-05	<p>On 11 May 05, a notice was sent to Yew Chung International School (YCIS) by the Contractor, providing their tentative blasting schedule on 12 May 05. It was shown that one of the blasting operations was scheduled at 09:30am, at when an examination was being held in YCIS.</p> <p>Upon receipt of the notice, a representative of YCIS lodged a complaint to the Contractor via the Project's hotline at 07:40 on 12 May 2005. The complainant expressed her objection to the blasting operation taken at 09:30am when the examination was taken place.</p> <p>The Contractor then agreed on one occasion only to delay the tunnel blast planned for 9:30am until 9:50am (i.e. 5 min after the examination). The complainant satisfied but did expect no future blasting during the examination period. According to the Engineer's Representative, the Contractor did not wish to make any commitment to ensure no blasting would be taken within the examination period.</p>	<p>A 1-day continuous noise measurement was conducted by the Environmental Team at Station NM1 on 26 May 05. According to the ER's record, two blasting operations were taken in the vicinity of YCIS on 26 May 05. One surface blast was taken at Butterfly Valley at 15:42 and one tunnel blasting was taken at South Portal at 16:56.</p> <p>The measurement results showed that the noise impact in term of Leq-5min and Leq-30min arising from the blasting operations was insignificant. No exceedance of construction noise criterion for examination period was recorded (Leq-30min < 65dB(A)).</p> <p>The complaint lodged was therefore considered not justifiable.</p> <p>However, in order to minimize the potential nuisance arising from the blasting noise and the siren sounds prior to blasting, the Contractor was recommended to consider scheduling the blasting operations beyond the examination periods.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50610	Government Quarters	10-Jun-05	<p>On 10 June 2005, the Resident Site Staff (Maunsell-Hyder Joint Venture) received a complaint from a resident of the Government Quarters at Caldecott Road. The complaint was concerned about the construction dust generation as a result of the construction activities of the Project at Butterfly Valley.</p> <p>The complainant had not specified which construction activities had contributed to the dust generation.</p>	<p><i>Site Observations</i></p> <p>According to the RSS's preliminary investigation, it was considered that soil nailing at Slope BV-S2 was the dominant dust source and was likely to be the activity of concern. The dust suppression measures taken were found inadequate to control the dust dispersion from the works. Noticeable dust dispersion from the soil nailing work could be observed.</p> <p><i>Corrective Actions</i></p> <p>After the Contractor was notified by the RSS of the complaint, immediate action was taken by the Contractor on the same day (10 June 2005).</p> <p>The dust mitigation measures for the soil nailing were enhanced. An additional thicker cover was used. Also, continuous water spray was applied to suppress the dust emission.</p> <p><i>Environmental Outcome</i></p> <p>The RSS made a response to the complainant on 10 June 2005. The complainant was informed of the rectification actions taken by the Contractor. No further adverse comment was received from the complainant.</p> <p><i>Conclusions</i></p> <p>Based on the RSS's information, this complaint is considered to be valid and related to the construction activities of the Project. However, corrective action had been taken by the Contractor immediately and the situation was found improved.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50712	A scattered house near South Portal and Tai Po Road Water Treatment Works Staff Quarters	12-Jul-05	<p>On 12 July 2005, a resident, whose house is located near South Portal and Tai Po Road Water Treatment Works Staff Quarters, lodged a complaint to the Contractor via the Project's hotline at 11:40am. The complainant expressed his concern on the nuisance caused by the blasting works at early morning (before 07:00 hours) and late night (after 23:00 hours).</p>	<p><i>Site Activity</i></p> <p>According to the information provided by the RSS, tunnel blasting works have been taken place in the concerned period in north bound tunnel from the Ventilation Adit towards the direction of the South Portal.</p> <p><i>Environmental Requirements</i></p> <p>In the EP, the EM&A Manual of the Project and the NCO, no requirement is specified for the control of blasting operation and the associated environmental impact, such as blasting noise.</p> <p>It should be highlighted that for carrying out blasting works, permission should be obtained by Mines Division of CEDD, but not under the jurisdiction of EPD.</p> <p>For carrying out the above-mentioned blasting operations, the Contractor has obtained a valid blasting permit from CEDD under the Dangerous Goods Ordinance (Cap. 295). Under this permit, the Contractor is allowed to carry out 24-hour blasting works within the designated area.</p> <p><i>Contractor's Actions</i></p> <p>Though the blasting noise is not under the control of any environmental related regulation and the Contractor is allowed to carry out 24-hour blasting, the Contractor would try to keep the blasts of concern undertaken between 07:00 to 23:00 hours. This arrangement could effectively reduce the potential nuisance to the residents within the more sensitive time period (23:00 to 07:00 on next day).</p> <p><i>Conclusions</i></p> <p>The subjected blasting operations were carried out by the Contractor under a valid blasting permit. The complaint lodged is therefore considered not justifiable.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50809	Government Quarters (8-10 Caldecott Road)	09-Aug-05	<p>On 9 August 2005, a resident of 8-10 Caldecott Road (Government Quarters) lodged a complaint to the Contractor via the Project's hotline at 14:30. The complainant expressed her concern on the nuisance caused by the blasting works undertaken at Butterfly Valley.</p> <p>Noise impact arising from the blasting works was one of the issues raised by the complainant.</p>	<p><i>Ad-hoc Noise Measurement</i></p> <p>An ad-hoc noise measurement was carried out on the roof of Government Quarters during a surface blast on 16 August 2005. According to the record of the RSS and the site observation, a surface blasting was undertaken at Butterfly Valley at around 15:38 on the monitoring day.</p> <p>The results show that the measured noise level in term of Leq-30min, i.e. 69.1 dB(A) during the surface blasting was well below the daytime construction noise criterion of 75 dB(A).</p> <p><i>Conclusion and Recommendation</i></p> <p>According to the results of ad-hoc noise measurement taken at Government Quarters on 16 August 2005, the measured noise levels (Leq-30min) did not exceed the noise criterion of 75 dB(A). In addition, the subjected blasting operations were carried out by the Contractor under a valid blasting permit. For the concern of noise impact, the complaint was considered not justifiable.</p>	Closed
50830	Government Quarters (8-10 Caldecott Road)	30-Aug-05	<p>The RSS received a public complaint from a resident of Government Quarters addressing two noise issues:</p> <ol style="list-style-type: none"> 1. Noise nuisance caused by drilling works at Butterfly Valley; 2. Noise nuisance due to blasting 0045 hrs of 28 August 2005. 	<p><i>Noise Measurement</i></p> <p>No exceedance was recorded for the routine noise monitoring at NM6 (Government Quarters). Ad-hoc noise measurement was conducted on 1 and 2 Sept 05. All measured noise levels complied with the noise criteria.</p> <p><i>Conclusion</i></p> <p>The complaint was considered not justifiable. However, the Contractor had taken proactive actions in order to minimize the nuisance of the residents, (1) to stop the rock breaking works at BVS2 and (2) to install temporary noise barriers for drilling works.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
50928	Government Quarters (8-10 Caldecott Road)	28-Sept-05	A resident of Government Quarters complaint about a blast undertaken at 0215hr on 28 Sept 05.	<p><i>Environmental Monitoring</i></p> <p>After receiving the complaint, the ET carried out a continuous noise measurement at Station NM6 (Government Quarters) from 29 to 30 September 2005. All the measured noise levels in term of Leq-5min are close to the baseline noise level. The noise levels after correction of baseline levels were all below the noise criterion of 50 dB(A).</p> <p><i>Conclusion</i></p> <p>The subjected blasting operations were carried out by the Contractor under a valid blasting permit. In addition, no noise exceedance was recorded for the ad-hoc noise monitoring. The complaint lodged is therefore considered not justifiable.</p>	Closed
51025	Caldecott Hill (2 Caldecott Road)	25-Oct-05	<p>A public complaint was received by the MWPMO of Highways Department on 25 October 2005. The complaint was subsequently refereed to the RSS and Environmental Team of Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project.</p> <p>The complaint was lodged by the management company of Caldecott Hill (No.2 Caldecott Road). It was about dust generation when construction vehicles, particularly dump trucks and concrete trucks, traveling along the Water Treatment Works (WTW) access road and its junction with Caldecott Road.</p> <p>According to the photos provided by the complainant, noticeable dust generation was observed during construction vehicles movement on the roads of concern.</p>	<p><i>Site Observations</i></p> <p>Ad-hoc site inspections were carried out on 25 and 26 Oct 05. On 26 Oct 05, the WTW access road was observed dry. Deposition of dusty materials was noted. Significant dust generation was identified during vehicle movement.</p> <p><i>Contractor’s Actions</i></p> <p>Mitigation actions were taken by the Contractor:</p> <ol style="list-style-type: none"> 1. One labour was appointed to water spray the concerned road junction and clear up of dusty materials deposited on the WTW access road. 2. Regular watering on access road by hose pipe was performed to keep the road wet. 3. All vehicles would be wheel-washed and loads of dusty materials would be covered before leaving the site. <p><i>Conclusions</i></p> <p>Based on the site observations, this complaint was considered to be valid and related to the Project works. However, enhanced dust mitigation measures were taken by the Contractor and the situation was found improved.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
51031	Po Leung Kuk Choi Kai Yau School	31-Oct-05	The resident site staff (MHJV) of R8-ENT received a complaint from the Principal of PLKCKY School. She commented that the blasting noise (nighttime and daytime) at Butterfly Valley became louder than before.	An ad-hoc noise measurement was taken by ET on 5 Nov 05 to evaluate the noise impact due to daytime surface blasting at the BV. The measurement results revealed that there has been no exceedance of noise level criteria. The complaint was therefore considered not justifiable.	Closed
51101	Butterfly Valley (Government Quarters)	1-Nov-05	<p>On 1 Nov 05, the Resident Site Staff received a complaint from a resident of the Government Quarters. On 2 Nov 05, a complaint of similar natures and same location was received by the Environmental Protection Department.</p> <p>The complainant was concerned about the following environmental issues:</p> <ol style="list-style-type: none"> Noise nuisance due to tunnel blasting works undertaken at midnights and in early mornings (3am to 5am); Noise nuisance due to operation of a generator after 11pm; Construction dust and daytime noise due to processing and stockpiling of crushed rocks at Butterfly Valley; Noise nuisance due to works outside tunnel in the early morning of 2 Nov 05. 	<p><u>Item 1: Noise nuisance due to tunnel blasting</u> For carrying out the above-mentioned blasting operations, the Contractor has obtained a valid blasting permit from CEDD. Under this permit, the Contractor is allowed to carry out 24-hour blasting works. As advised by the Contractor, all the blasting operations had been completed by 12 Nov 05.</p> <p><u>Item 2: Noise due to operation of a generator after 11pm</u> According to the Construction Noise Permit issued by EPD, one generator was allowed to be operated after 11pm at South Portal area outside the tunnel. In view of the provision of acoustic enclosure and the separation distance from the generator to Government Quarters (around 300m), the noise impact arising from this generator onto the residents of the Quarters was believed to be insignificant. During the ET's investigation on 11 Nov 05, no engine-like noise generated from the construction site could be identified.</p> <p><u>Item 3: Dust and noise due to handling of crushed rocks</u> No noise exceedance was recorded. During the weekly site inspections, deficiencies regarding inadequate dust mitigation measures for the crushed rock processing and stockpiling were occasionally observed. Dry / uncovered stockpiles and dust emissions from crushed rocks handling were sometimes noted.</p> <p><u>Item 4: Noise from works out of tunnel in morning of 2 Nov 05</u> According to the RSS's site records, there has been no activity outside the tunnel in the early morning of 2 November 2005. Work was undertaken deep inside the tunnel during the concerned period. The mentioned noise nuisance might not be related to R8-ENT Project. An ad-hoc noise measurement was carried out by ET from 8 to 10 November 2005 in order to evaluate the noise at Quarter's residents and no exceedance was recorded.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p><u>Conclusion</u></p> <p>Based on the information obtained, environmental monitoring results and site observations, this complaint was considered not justifiable, except for the concern of dust nuisance due to crushed rock processing.</p>	
51205	Caldecott Road junction	5-Dec-05	<p>The complaint was lodged by the management company of Villa Carlton. The complainant mentioned that several complaints from the occupants of Villa Carlton were received, against the dust emission when they drove to Kowloon via the Caldecott Road Junction. She also considered that the amount of water spraying by the Contractor was insufficient to suppress dust emission at Caldecott Road Junction.</p>	<p><u>Complaint Record</u></p> <p>A similar complaint (Log no. 51025) was received on 25 Oct 05 from Caldecott Hill. Significant dust emission was noted when construction vehicles traveling along the WTW access road and its junction with Caldecott Road.</p> <p>With implementation of enhanced dust mitigation measures, the situation was found improved and satisfactory.</p> <p><u>Site Observations</u></p> <p>Since Nov 05, in order to observe the Contractor's actions taken for the above-mentioned complaint, the area of interest was included during the weekly environmental audit. No deficiency had been noted at this area during the audit.</p> <p>After receiving this new complaint (Log no.51205), several ad-hoc site inspections were carried out on 6, 8 and 14 Dec 05. In addition, the RSS of the Project had carried out daily checking of the condition of the Caldecott Road Junction.</p> <p>Sufficient dust mitigation measures had been implemented by the Contractor. The condition was found satisfactory. Therefore, this complaint was considered not justifiable.</p> <p>However, it is noted that the Contractor had stepped up dust mitigation measures to further improve the condition at Caldecott Road junction.</p>	Closed

Log Ref.	Location of Concern	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
60204	Garden Villa	4-Jan-06 (by ETL)	<p>A public complaint was received by the Environmental Protection Department on 3 January 2006. The complaint was subsequently referred to the Environmental Team of Route 8 – Eagle’s Nest Tunnel and Associated Works (R8-ENT) Project on 4 January 2006.</p> <p>According to EPD’s information, the complaint was lodged by a complainant, who walked along Tai Po Road on 1-2 January 2006. The following information was given by EPD for our investigation:</p> <ul style="list-style-type: none"> • Time of concern: 1-2 January 2006 (Daytime) • Suspected site area of concern: ENT’s Toll Plaza and Administration Building. • Dust and noise nuisance was noted by the complainant when he passed Garden Villa. • Noise from wood saw and crane or alike was noted. 	<p>A. Construction Noise Impact</p> <p>According to the Contractor’s information, construction activities were carried out on 1 and 2 Jan 06, including:</p> <ul style="list-style-type: none"> • Erection and dismantling of formwork • Fixing water pipe <p>All the equipment operated by the Contractor on 1-2 Jan 06 complied with the permissible equipment stated in the CNP.</p> <p>On 1 Jan 06, noise monitoring was carried out. All the results complied with the noise criterion.</p> <p>B. Construction Dust Impact</p> <p>Erection and dismantling of formwork and fixing water pipe were considered not dust emissive in nature.</p> <p>For stockpiles of materials in Toll Plaza area, dust mitigation measures had been implementing by the Contractor. The condition in term of dust control was found satisfactory during the audit sessions on 4 and 11 Jan 06.</p> <p>Since December 2005, all TSP monitoring results complied with the Action / Limit Level.</p> <p>Conclusion</p> <p>Based on the information given, site observations and environmental monitoring results, this complaint was considered not justifiable.</p> <p>Nevertheless, the Contractor was reminded to adopt good site practice to minimize the environmental impacts at the nearby sensitive receivers</p>	Closed