

**Proposed Extension of Public Golf Course
at Kau Sai Chau Island, Sai Kung**

**Monthly Environmental Monitoring & Audit (EM&A) Report
for September 2007**

(Report No. 382210/021)

Report Authorized For
Issue By:

For and on Behalf of
Black & Veatch Hong Kong Limited

Black & Veatch Hong Kong Limited
Room 1201-09, Millennium City 5,
418 Kwun Tong Road,
Kowloon, Hong Kong

The Hong Kong Jockey Club
One Sports Road
Happy Valley
Hong Kong

October 2007

Table of Content

Executive Summary

1.Introduction

- 1.1 Background of the Project*
- 1.2 Purpose of the Report*
- 1.3 Structure of the Report*

2.Project Information

- 2.1 Background*
- 2.2 Site Description*
- 2.3 Project Organization*
- 2.4 Construction Programme*
- 2.5 Status of Environmental Submission*
- 2.6 Summary of EM&A Requirements*

3.Environmental Monitoring Requirements

- 3.1 Air Quality*
- 3.2 Water Quality*
- 3.3 Ecology*
- 3.4 Landscape and Visual*
- 3.5 Archaeology (Watching Brief)*
- 3.6 Land Contamination*

4.Implementation Status on Environmental Protection Requirements

5.Monitoring Results

- 5.1 Air Quality*
- 5.2 Water Quality*
- 5.3 Ecology*
- 5.4 Archaeology (Watching Brief)*

6.Environmental Site Auditing

7.Environmental Non-Conformance

- 7.1 Summary of Environmental Non-Compliance*
- 7.2 Summary of Environmental Complaint*
- 7.3 Summary of Environmental Summons*

8.Future Key Issues

- 8.1 Key Issues for coming month*
- 8.2 Monitoring Schedule for the coming month*
- 8.3 Construction programme for the next three month*

9.Recommendations and Conclusions

List of Figure

- 1.1 Master Layout Plan of the Proposed Third Golf Course
- 1.2 Project Organisation and Lines of Communication
- 3.1 Proposed Air Quality Monitoring Locations
- 3.2 Proposed Water Quality Monitoring Locations (Construction phase)
- 3.3 Proposed Ecology Monitoring Locations
- 3.4a Locations of Coral and Seagrass Monitoring (Sites D2, D3 and C)
- 3.4b Indicative locations of the tagged corals at Site B2 under the revised monitoring regime
- 3.5 Coral Transplantation Location
- 3.6 Watching Brief Monitoring Area
- 3.7 Sampling Locations for Land Contamination

List of Table

- Table 1.1 Structure of the Report
- Table 2.1 Summary of Compliance with EP Conditions
- Table 2.2 Summary of Impact EM&A Requirements
- Table 3.1 Action and Limit Levels for 1-hour TSP
- Table 3.2 Action and Limit Levels for 24-hour TSP
- Table 3.3 TSP Monitoring Parameter and Frequency
- Table 3.4 Air Quality Monitoring Equipment
- Table 3.5 Derived Summaries of Action and Limit Levels for Marine Water Quality
- Table 3.6 Derived Summaries of Action and Limit Levels for Freshwater Water Quality
- Table 3.7 Water Quality Monitoring Parameter, Frequency and Locations
- Table 3.8 Water Quality Monitoring Locations during Construction Phase
- Table 3.9 Analytical Methods to be applied to Water Quality Samples
- Table 5.2-1 Marine water Exceedance Summary August to September 2007
- Table 5.2-2 Freshwater Exceedance Summary August to September 2007
- Table 5.2-3 Pesticides Monitoring Results August to September 2007
- Table 5.3-1 Conditions of tagged corals at Site B2
- Table 5.3-2 Conditions of tagged corals at Site C
- Table 5.3-3 Conditions of tagged corals at Control Site
- Table 5.3-4 Conditions of transplanted corals
- Table 6.1 Summary of Environmental Licensing and Permit Status

List of Annex

- Annex A Tentative Construction Programme
- Annex B Monitoring Programme for the reporting month
- Annex C Event Action Plan
- Annex D Implementation status on Environmental Protection Requirements
- Annex E Monitoring results
- Annex F Calibration Certificates
- Annex G Monitoring Programme for the next three months
- Annex H Construction Programme for the next three months

	Name	Signature	Date
Prepared	Malcolm Leung		Oct 2007
Checked	Manuel Chua		Oct 2007
Reviewed	PK Lee		Oct 2007

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
Monthly EM&A Report

DOCUMENT CONTROL			Proposed Extension of Public Golf Course at Kau Sai Chau, Sai Kung	No. 382210/021
AMENDMENT RECORD				Prepared by: Malcolm Leung
Monthly EM&A Monitoring Report – September 2007			Client: Hong Kong Jockey Club	Initials: ML
				Date: Oct 2007
Pages:	Date:	Issue No.	Description:	Initials:
All	Oct 07	1	Monthly EM&A Report for submission to EPD	ML

Your ref:
Our ref: 40040032/CERT/26_07.doc

**Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
(Independent Environmental Checker)**

CHECK CERTIFICATE

1. We certify that professional skill and care have been used in the checking of the Environmental Team's (ET) No.21 Monthly EM&A Report for September 2007 for the construction of Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung.
2. We certify that the ET's EM&A programme for the reporting period has been satisfactorily executed and the No. 21 Monthly EM&A report for September 2007 has been verified.
3. We comment that our evaluation of the ET's EM&A is based on a random audit process which cannot be guaranteed to have all non-conformities identified.

Signed



Independent Environmental Checker

Name Gary Tam

of Hong Kong Productivity Council
3/F., HKPC Building,
78 Tat Chee Avenue,
Kowloon

Date 8th October 2007

Executive Summary

This is the twenty-first Monthly Environmental Monitoring and Audit (EM&A) Report prepared by Black & Veatch, the designated Environmental Team (ET), for the Project "Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung". The construction works of golf course was commenced on 16th January 2006. This report presents the results of the EM&A works conducted in the month of September 2007 (25th August to 24th September 2007).

Summary of construction works undertaken during this report period

No dredging of the permanent intake and outfall pipelines for the desalination plant had been carried out. Hong Kong Jockey Club (HKJC) submitted further supplementary information to EPD for the discharge licence application during the reporting month and in progress. It is very critical to get the discharge licence of the desalination plant before the coming dry season (October 2007).

Some hydroseeding areas were not fully covered with hydroseed and re-hydroseeding was required. The shrub planting was commenced in late April 2007 at the hydroseeded slopes and was in progress. According to site record, turf planting (tees, fairways and green) was completed at Holes 3 to 8, 11, 14 and 15. Holes 12, 13, 16 and 18 were capped with sand and planting with turf. Central portion (Holes 1, 2, 9 and 17) will be the last portion to be planted with turf. Applications of fertilizers and pesticides at Holes 3-8 & 11-16 and Holes 3-8, 11, 13-16 & 18 respectively were recorded. All measured pesticides concentrations at all fresh water and marine monitoring stations was undetectable.

The construction of the closed low flow drainage for the East Course was in progress and mostly completed. No rainstorm event was recorded during the reporting month.

Few improvements of the temporary drainage were observed, more portions of the permanent drainage were commenced to use and collect surface runoff and more portions of the site covered by turfing during reporting months. Moreover, few rains were recorded according to the Hong Kong Observatory, no significant silty runoff was observed during this reporting month. Since the start of this year wet season, ET and the Engineer repeatedly reminded the Contractor to prevent silty/nutrient/pesticides runoff to the streams and marine water. The Contractor was reminded to critically review and revise the Temporary Drainage Management (TDMP) according to the actual site progress, install sufficient temporary drains and provide sufficient desilting facilities in order to prevent/divert/collect the silty runoff and discharge to the streams or marine according to the discharge licence and Water Quality Objectives (WQOs) of Port Shelter in accordance with the Water Pollution Control Ordinance (WPCO) and its subsidiary regulations.

Artificial rocks were observed depositing at downstream of Stream A after heavy rains on 3rd July 2007 which had already been occurred once last year (June 2006). The Contractor reported the rocks were cleared by hand without any use of machine during last reporting month (August 2007). Subject to the agreement by the Engineer and IEC that the rocks removal had been satisfactorily completed, the Contractor would conduct subsequent reinstatement works during the coming dry season. The Contractor was reminded to prevent the occurrence of the similar case before the completion of reinstatement.

For the temporary Sewage Treatment Plant (STP), sewage effluent was stored temporarily in a temporary storage tank since early May 2007 and discharge off-site by licenced Contractor. Algae blooms were occurred at the upstream of fresh water inland marsh on 26 June and 10 July 2007. The Contractor conducted site inspection with the Engineer on 16 July 2007 and confirmed that the discharge pipe connecting the sewage treatment plant to the temporary holding tank had been found damage and causing leakage which leading to continuous discharge of sewage water flowing into the fresh water inland marsh through the permanent drainage system. This coincided with the continuous exceedances of nutrient concentrations recorded at downstream of fresh water inland marsh. The Contractor was reminded to take immediate and effective remedial actions to properly operate and maintain the wastewater treatment

facilities in compliance with the discharge licence together with the provision of supportive water quality monitoring results of the sewage effluent. The Contractor was also reminded to pay particular attention and strictly follow all specific and standard conditions required by discharge licence of their sewage treatment plant. No information was submitted by CHEC regarding the STP performance during the reporting and previous months. Moreover, after the new installed connecting pipeline from the STP to temporary holding tanks since mid-July, the concentration of ammonia at the downstream of the fresh water inland marsh was found decreased gradually and later kept undetectable since the previous months. Nutrients (nitrogen compounds), presented in the Fresh Water Inland Marsh, were found decreased to the levels similar to those of other streams during the reporting month.

Terrestrial ecological monitoring was carried out in September 2007. There was no heavy rainfall during the reporting month. The flow in the Stream B was found clear and there was no sediment entering the stream from the recently constructed culvert. Aquatic life including Atyid shrimps and freshwater snails were recorded in Stream B again.

Sedimentation in Stream C was reported in November 2006 after the heavy rainfalls. Much of the fine sediments deposited in November 2006 had been gradually reduced. Further coarse sediments were found at the Stream C after rains since sand capping commenced at the end of July 2007. Low aquatic fauna was found in the Stream C during the reporting month. Preventive mitigation measures should be taken by the Contractor immediately to prevent any further sedimentation incidents to all identified streams.

As further discussed with the Jockey Club and the Engineer, sand capping is one of the feasible measures but it takes time and needs to match with the construction programme. The Contractor was recommended to implement immediate actions, but not limited to, such as cover the exposed area near the stream courses with tarpaulin to reduce the silty runoff during the rainstorms, provide sandbags along the buffer zones of the Streams B & C as an strengthen measures. The effectiveness of the proposed mitigation measures on site would be further review. The Contractor was requested to provide more practical mitigation measures in their proposal for our review in order to effectively prevent silty runoff to all stream courses.

Finishing works for permanent bridges at the Streams A, B, C and the Fresh Water Inland Marsh were in progress. Concrete batching plant was dismantling was observed on 31st August 2007.

Environmental Monitoring and Audit Progress

A summary of monitoring activities in this reporting period is shown as follows:

24-hour Total Suspended Particulates (TSP) monitoring at GCA B1	6 times
Water quality monitoring (marine + freshwater)	4 times
Terrestrial Ecology	1 time
Marine Ecology	2 times
Landscaping & Visual	2 times

Air Quality

6 sets of 24-hour TSP monitoring were carried out on 25th, 31st August, 6th, 12th, 18th and 24th September 2007 at Bungalow A (GCA B1) at Kau Sai Chau during this reporting month.

Water Quality

4 sets of water quality monitoring were carried out on 27th August, 3rd, 10th and 17th September 2007 at 9 marine and 7 freshwater monitoring locations. No heavy rainstorm was hoisted during this reporting month.

Terrestrial Ecology

Terrestrial ecology was conducted on 14th and 20th September 2007. The entire project site was under construction, and the demarcation of the stream buffer zone had been established for the Streams A, B and C. The permanent access bridges for the Streams A and C had been constructed with the piers outside Stream buffer zone demarcation. The downstream section of the Stream A channel was accidentally filled up by boulders before and some remedial works have been implemented by the Contractor to clear the rubbles manually and a restore plan will be prepared by the Contractor. The buffer zones for the Streams A, B, and C were basically intact. The flow in Stream B was found clear and there was no sediment entering the stream from the recently constructed culvert. Aquatic life including Atyid shrimps and freshwater snails were recorded in Stream B again. But sedimentation was still observed in Stream C, and the abundance of aquatic fauna, in particular caridian shrimps, was found very low. Stream D was in natural conditions similar to the condition during the Baseline Survey, and the aquatic fauna abundance was found resuming.

Marine Ecology

Marine ecology monitoring were conducted on 15th, 16th, 22nd and 23rd September 2007 at Site B2, Site C, Control Site and the transplanted coral site. A seawall had constructed at Site B2 as the landing point of the temporary barging point. The number of tagged corals at Site B2 was increased from 20 to 50 in April 2006, which included the original B11 to B-20 and newly established B-21 to B-60. The distribution of these tagged corals was 20 to the north of the barge, 20 to the south of the barge, and 10 within the area of the barge. In previous monitoring, 5 tagged corals (B-19, B-50, B-51, B-59 & B-60) were found missing in Site B2 due to wave action and weather conditions. In the present survey, minor sedimentation on some of the tagged corals at Site B2 were observed, and one more colony (i.e. B-16) was found missing. New or further mortality on B-12, B-17, B-54 and B-55 were found in the present survey. But these mortality records were still below the Action Level for the coral monitoring, i.e. "a 15% increase in the percentage of partial mortality of corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites". The Control Site still remained similar conditions as during the Baseline Survey (no mortality, sedimentation or bleaching was found), except the missing of X-05 colony. 86 out of the 89 transplanted corals were recovered and their conditions were similar with the baseline conditions (during the transplantation process).

Landscaping & Visual

Landscape and visual monitoring and site audits were carried out on 7th and 21st September 2007. Site formation, shaping, hydroseeding and planting works are being carried out at present. The Contractor shall take measures to improve the condition of damaged trees described in this report and provide adequate watering to newly hydroseeded area, planted shrubs and transplanted trees.

Damaged trees next to the administration building were still unprotected after being damaged by the adjacent construction activities.

All transplanted trees were in fair condition except for T848. Mal-pruning of transplanted trees has not been rectified. Construction material was stockpiled within tree protection zones. A statement on the cause of death of tree T925 recorded in the last report is still outstanding.

The following works have been outstanding since July 2006: (i) Carry out surgery to damaged trees, (ii) Report the cause of death of tree T925, (iii) Re-fix the label of retained tree for easy identification, (iv) Maintain the tree protection zone required and remove all construction material / debris from the tree protection zone, (v) More frequent watering for transplanted trees, planted vegetation and hydroseeded grass and (vi) Rectify the mal-pruning practice of the transplanted trees.

Environmental Site Auditing

Four weekly joint environmental site audits were carried out on 31st August, 5th, 11th and 18th September 2007 with the Engineer and the Contractor's representatives. A monthly joint environmental site audit was carried out on 18th September 2007 by the Engineer, the Contractor's Representative and the Independent Environmental Checker (IEC).

Environmental Non-conformance

Air Quality

No exceedance of 24-hour TSP was recorded at GCA B1 during the reporting month.

Marine Water Quality

Two exceedances of turbidity were recorded at M_Marsh and TTC. Five exceedances of suspended solids were recorded at M_RO1, KLW, TTC, M_BP and KS. Moreover, two exceedances of ammonia nitrogen were recorded at TTC and KS. Three exceedances of chlorophyll a were recorded at M_Marsh and TTC. Exceedances were mainly due to the natural variation of the marine water and considered non-project related.

Freshwater Quality

Twelve exceedances of turbidity and eleven exceedances of suspended solids were recorded at the Streams B and C. Exceedances were mainly due to silty runoff from insufficient temporary and mitigation measures provided on site. Exceedances were considered project related. Moreover, five exceedances of ammonia nitrogen were recorded at the Streams A, B & C and the downstream of the Fresh Water Inland Marsh. Eleven exceedances of nitrate were recorded at the Streams B & C and the downstream of the Fresh Water Inland Marsh. Fourteen exceedances of total inorganic nitrogen and twelve exceedances of chlorophyll a were recorded at the Streams A, B & C and the downstream of the Fresh Water Inland Marsh.

Besides, ammonia nitrogen concentrations were low in comparison with previous months since last reporting month. The leakage of sewage effluent from the connection pipeline between the temporary sewage treatment plant and the temporary storage tank reported in previous reporting months considered was halted and the condition considered was rectified. Nutrients due to the incident of leakage was considered settled or stabilized. Exceedances of nitrogen compounds were considered non-project related.

As the upstream monitoring locations at Streams B & C (F_UB and F_UC) are located within the construction work area since September 2006, they have represented and have become impact monitoring stations instead of control stations in the environmental monitoring.

All notifications of exceedances and the subsequent exceedance incident reports were/would be forwarded to the relevant parties.

For those considered project-related exceedances at fresh water and marine water, the Contractor was required to critically review the temporary drainage management plan (TDMP) and implement necessary improvement to prevent silty runoff from the construction site to the marine water and stream courses. The Contractor was also requested to rectify the situation as soon as possible. The water quality monitoring results could not reveal that the temporary drainage installed on site was sufficient or not since there was low rainfalls during this reporting month.

No environmental complaint / summon was received in this reporting month.

Implementation Status of Environmental Mitigation Measures

The Contractor was reminded the following issues and to take actions if necessary:

Air Quality

- Increase frequency of watering at main haul roads and rock breaking areas;
- Pave major haul roads with gravels/concrete to minimize the dust emission due to the heavy traffic;
- Cover all soil/sand/aggregates stockpiles with tarpaulin or other measures to reduce the dust emission; and
- Properly install hoarding where a site boundary adjoins a road, street, service lane or other area accessible to the public.

Waste Management

- Properly dispose of the vegetation stockpiles, general refuse and construction waste off-site;
- Provide construction waste sorting area;
- Provide sufficient mobile toilets at remote site areas;
- Properly maintain the temporary sewage treatment plant; and
- Properly locate the chemical waste storage facility on-site and provide regular dispose to prevent accumulate of chemical waste.

Ecology

- Reinstate the downstream of the Stream A as soon as possible;
- Maintain the reinstated conditions (planting shrub) at Stream B2 buffer zone since March 2007 and Stream C buffer zone since May 2007; and
- Rectify and remediate the silt deposit at Streams A, B and C after rainstorm events.

Water Quality

- Implement temporary drains according to Temporary Drainage Management Plan (TDMP) to avoid silty/nutrient/pesticide runoff;
- Provide sufficient preventing and/or mitigation measures at all open cut areas to avoid silty runoff;
- Minimize the water quality impact when undertaking cut-and-fill works and turfing. It is important to provide sufficient temporary drainage system at critical areas to confine, collect and provide proper treatment before discharging to marine water and stream courses to ensure that the water quality is complied with WQO requirements;
- Provide sufficient treatment facilities before water discharges from construction site;
- Maintain the integrity of silt curtains and remove settled silt within the silt curtain which have been installed outside the fresh water inland marsh, near Hole 2, near Hole 4, inactive culture zone and Stream A;
- Strengthen the preventive/interim measures for avoiding silty runoff from the exposed areas to the low lying areas. More frequent maintenance of the silt fence is necessary; and
- Provide sufficient temporary drainage system at all temporary bridges.

Landscape & Visual

- Protect the retain trees with sufficient watering mainly located at the administration building;
- Provide sufficient water to the retain trees, transplanted trees, hydroseeding areas;
- Provide tree protection zone for all retain tree at the administration building; and
- Provide incident report for the death of the retain trees.

Future Key Issues

General issues to be considered in the coming month include:

- Potential dust generation from activities on-site : permanent drainage/irrigation system construction, and soil/sand/aggregates stockpiles;
- Turf establishment at southern East Course;
- Implement sufficient and improve the temporary drainage system (and make use of the permanent drainage system) on site to prevent silty/nutrients/pesticides runoff discharging to marine and stream courses;
- Apply the discharge licence for the desalination plant near to the existing KSC pier before operation;
- Dispose of construction wastes, vegetation and general refuse off-site; and
- Hydroseed the bare ground/temporary/permanent slopes according to the golf course design.

Key issues at particular areas:

- Review and revise the Temporary Drainage Master Plan (TDMP) for the silty runoff and turf establishment period prepared by the Contractor for Engineer and Jockey Club's approval;
- Carry out water quality monitoring for nutrients/pesticides due to turf establishment;
- Carry out coral monitoring for the transplanted corals on quarterly basis; and
- Carry out coral monitoring when desalination plant operates in dry season.

1. Introduction

1.1 Background of the Project

1.1.1 Black & Veatch (hereinafter called the “ET”) was appointed by Hong Kong Jockey Club (hereinafter called the "Project Proponent") to undertake Environmental Monitoring and Audit (EM&A) for “Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung” (hereinafter called the “Project”). Under the requirements of Section 4 of Environmental Permit EP-224/2005, EM&A programme as set out in the EM&A Manual is required to be implemented. In accordance with the EM&A Manual, environmental monitoring of air quality, water quality, terrestrial and marine ecology, landscape and visual, archaeology (watching brief) and land contamination are required for the Project. Application for Variation of an Environmental Permit by the Project Proponent on 2 August 2006 (Application No. VEP-222/2006) and the EP was superseded by EP-224/2005/A.

1.1.2 This report summarises the environmental monitoring and audit works for the Project in September 2007 (from 25th August to 24th September 2007).

1.2 Purpose of the Report

1.2.1 This is the twenty-first EM&A report which summarizes the impact monitoring results and audit findings for the EM&A programme during the reporting period from **25th August to 24th September 2007**.

1.3 Structure of the Report

1.3.1 The structure of the report is shown in Table 1.1.

Table 1.1 Structure of the Report

Section		Description
1	Introduction	Details the scope and structure of the report
2	Project Information	Summarizes background and scope of the project, site description, project organization and contact details, construction programme, the construction works undertaken and the status of environmental permits/licenses during the reporting period.
3	Environmental Monitoring Requirement	Summarizes the monitoring parameters, programmes, methodology, frequency, location, action and limit levels, event action plans, environmental mitigation measures as recommended in the EIA report and relevant environmental requirements.
4	Implementation Status on Environmental Mitigation Measures	Summarizes the implementation of environmental protection measures during the reporting period.
5	Monitoring Results	Summarizes the monitoring results obtained in the reporting period.
6	Environmental Site Auditing	Summarizes the audit findings of the weekly site inspections undertaken within the reporting period.
7	Environmental Non-conformance	Summarizes any monitoring exceedance, environmental complaints and environmental summons within the reporting period.
8	Future Key Issues	Summarizes the impact forecast and monitoring schedule for the next three month (25 Aug 2007 – 24 Oct 2007).
9	Recommendations and Conclusions	Lists out any recommendations and provides an overall conclusion of the results and findings of the EM&A programme for the reporting period.

2. Project Information

2.1 Background

2.1.1 The Project comprises the following major components:

- Construction of the third 18-hole public golf course on the east side of the island, south of the existing golfing area;
- A new irrigation lake to collect surface runoff from the new 18-hole golf course. Water stored at the new irrigation lake can also be diverted to existing reservoir for tertiary treatment and recycling;
- A new desalination plant adjacent to the existing pier to serve as an additional irrigation water supply for the new golf course during dry season; and
- Expansion of existing administration and maintenance buildings.

2.1.2 The potential environmental impacts of the Project have been studied in the Environmental Impact Assessment (EIA) report (EIAO Register No. AEIAR- 091/2005). The EIA was approved on 14 November 2005 under the EIAO. An Environmental Permit (EP-224/2005) was granted on 28 November 2005. Application for Variation of an Environmental Permit by the Project Proponent on 2 August 2006 (Application No. VEP-222/2006) and the EP was superseded by EP-224/2005/A.

2.2 Site Description

2.2.1 A layout plan of the Project is provided in **Figure 1.1**.

2.3 Project Organization

2.3.1 Project organization and lines of communication are shown in **Figure 1.2**.

2.4 Construction Programme

2.4.1 The tentative construction programme for the Project is presented in **Annex A**. The construction works were commenced on 16 January 2006 and were scheduled to be completed by end of July 2007. According to the present schedule, the Project is to be extended.

2.5 Status of Environmental Submission

2.5.1 A summary of the reporting requirement for compliance with EP conditions of the Project is listed in Table 2.1.

Table 2.1 Summary of Compliance with EP Conditions

EP-224/2005	Environmental Permit Submission	Status	Remarks
2.3	Management organization of the main construction companies and/or any form of joint ventures associated with the construction of the Project.	Submitted	At least one week before the commencement of construction of the Project.
2.4	Contamination Assessment Plan (CAP) submission. If land contamination is confirmed by the site investigation, submission of a Remediation Assessment Plan (RAP) including a Contamination Assessment Report (CAR) is required.	Submitted	The Final Site Remediation Report (FSRR) was approved by EPD in this reporting month.
3.6	Detailed methodology for Coral Transplantation submission to the Director for approval.	Approved	Approved on 16 th November 2006. Coral transplantation at Site D2 was completed in early December 2006. No dredging work for the desalination plant's intake and outfall pipelines was carried out. AFCD has no comment for the coral donor site survey, coral mapping survey and coral transplantation reports.
4.1	EM&A Manual (revised)	Submitted	At least two weeks before commencement of construction of the Project.
4.3	Baseline Monitoring Report	Submitted	At least two weeks before commencement of construction of the Project
4.5	Monthly EM&A Report	Submitted	within 10 working days after the end of the reporting month
5.1	Set up a dedicated web site and notify the Director in writing the Internet address.	Completed	Within 6 weeks after the commencement of construction of the Project (http://www.kscgolf.com/ema/index.asp)
3.4	Variation of Environmental Permit for the construction of the temporary crossings at Stream B during wet season.	Completed	Variation of Environmental Permit was approved on 18 th August 2006. The revised registered EP was EP-224/2005/A.

2.6 Summary of EM&A Requirements

2.6.1 The EM&A programme requires environmental monitoring for air quality, water quality, terrestrial and marine ecology, landscape and visual, archaeology (watching brief) and land contamination. The EM&A requirements for each parameter are described in subsequent sections, including:

- All monitoring parameters;
- Action and Limit Levels for all environmental parameters;
- Event and Action Plans; and
- Environmental mitigation measures, as recommended in the project EIA final report.

2.6.2 A summary of impact EM&A requirements is presented in Table 2.2.

Table 2.2 Summary of Impact EM&A Requirements

Impacts	Parameters/descriptions	Locations	Frequencies	Duration
Air Quality	24-Hour TSP	1 Location	Once every 6 days	During Construction
	1-Hour TSP	1 Location	Three times in every 6 days	During Construction (As required when complaint received)
Water Quality	Dissolved Oxygen, Temperature, Turbidity, pH, Salinity and SS	9 marine and 7 freshwater locations	First 3 months 3 times a week, mid-ebb and mid-flood tides. If there is no exceedance occurs for the first 3 months, reduce to once per week.	During Construction
	Dissolved Oxygen, Temperature, Turbidity, pH, Salinity, SS, NO3-N, NO2-N, NH3-N, TP and selected pesticides.	9 marine and 7 freshwater locations	Once per week. If there is no exceedance occurs, monitoring frequency is subjected to change and shall be agreed with EPD.	During Construction: turf establishment period (permanent low flow drainage is not completed)
	Dissolved Oxygen, Temperature, Turbidity, pH, Salinity, SS, NO3-N, NO2-N, NH3-N, TP, Chl-a and selected pesticides.	9 marine and 6 freshwater locations	A 2-year of monitoring period for the operation phase is proposed. Monitoring should be carried out on bi-weekly basis for the first 12 months, after when the frequency will be reviewed by EPD.	During Operation
	Dissolved Oxygen, Temperature, Turbidity, pH, Salinity, SS, NO3-N, NO2-N, NH3-N, TP, Chl-a and selected pesticides	8 marine locations	Additional water quality monitoring shall be carried out after heavy rain storm or when there is an overflow event from the reservoir, irrigation buffer lake or detention ponds/tanks.	During Construction and Operation
Terrestrial Ecology	Monitoring aquatic fauna	Streams B, C & D	Once a month	During Construction
	Environmental Site Inspection mainly on intact of buffer zones	Streams A, B and C	Once a week	During Construction

Impacts	Parameters/descriptions	Locations	Frequencies	Duration
Marine Ecology	Transplanted corals	Site D2	Quarterly for one year after transplantation	During construction
	Natural corals	Site C, Site B2, Site D2, and the Control Site.	For Site D2 and the Control Site: Weekly at the first two weeks of dredging works for the desalination plant pipelines. If no exceedance was recorded, the monitoring schedule would be changed to biweekly till the pipeline construction works are finished. For Site C, B2 and the Control Site: Monthly for the first three months of the construction phase. If no exceedance was recorded, the monitoring schedule would be changed to quarterly during the rest of the construction phase.	During Construction
		Site C, Site D2 and the Control Site.	First three months would be monthly conducted during the first two years of the operation phase. If no exceedance was recorded, the monitoring schedule would be changed to semi-annually, i.e. once in dry season and once in wet season.	During Operation
	Seagrass bed	Site D3, and at Site D2 if seagrasses were found during the baseline monitoring.	Weekly during the first two weeks of dredging works, and then biweekly till the pipeline construction works are finished.	During Construction
		Site D3, and at Site D2 if seagrasses were found during the baseline monitoring.	During the first two years of the operation phase. The monitoring schedule during the first three months would be monthly. After that, the monitoring schedule would be changed to semi-annually, i.e. once in dry season and once in wet season.	During Operation
	Landscape and Visual	Audits to ensure effective implementation of mitigation measures	Project area and at visual sensitive receivers	Auditing inspections and reporting shall be undertaken once every two weeks of the construction phase and once every two months of the operation phase.
Archaeology (Watching Brief)	Monitor archaeological potential sites at major cut areas	Hole 2, Hole 11, Hole 12, Hole 14, Hole 15 and Hole 16.	The archaeologist should keep the AMO informed of the progress of watching brief. The archaeologist should submit progress reports every 3 months during the programme of the watching brief.	During Construction
Land Contamination	Total Sulphur and Total Lead	Locations 2, 3, 6, 7 & 8	One month before commencement of work at the identified 5 hotspots	During Construction
General Site Conditions	Environmental Site Inspection	Works areas and areas affected by works	Periodically (weekly basis)	During Construction

3. Environmental Monitoring Requirements

3.1 Air Quality

Monitoring Requirement

- 3.1.1 24-hour TSP monitoring was carried out at GCA B1 to monitor the construction dust impact level in this reporting period.
- 3.1.2 The established Action/Limit Levels (AL levels) for the 1-hour and 24-hour TSP monitoring works are summarized in Table 3.1 and Table 3.2.

Table 3.1 Action and Limit Levels for 1-hour TSP

Location	Description	Action Level	Limit Level
GCA B1	Bungalow A adjacent to Kau Sai Chau Public Golf Course Administration Building	277.2 $\mu\text{g m}^{-3}$	500 $\mu\text{g m}^{-3}$

Note: The action levels for GCA B1 are developed based on baseline monitoring result.

Table 3.2 Action and Limit Levels for 24-hour TSP

Location	Description	Action Level	Limit Level
GCA B1	Bungalow A adjacent to Kau Sai Chau Public Golf Course Administration Building	187.4 $\mu\text{g m}^{-3}$	260 $\mu\text{g m}^{-3}$

Note: The action levels for GCA B1 are developed based on baseline monitoring result.

Monitoring Parameters, Frequency and Programme

- 3.1.3 The monitoring parameters and frequency are summarized in Table 3.3. The monitoring programme for the reporting period is shown in **Annex B**.

Table 3.3 TSP Monitoring Parameter and Frequency

Parameter	Frequency
24-hour TSP	Once every 6 days
1-hour TSP	3 times every 6 days (as required in case of complaints)

Monitoring Locations

- 3.1.4 In accordance with the EM&A Manual, one monitoring station (GCA B1) was selected and shown in **Figure 3.1**.

Monitoring Equipment

- 3.1.5 24-hour and 1-hour TSP (in case of complaints received) were performed using High Volume Samplers (HVS) and measured in-situ respectively. 24-hour TSP level of samples were collected using filters and High Volume Sampler and the collected samples were determined by a local HOKLAS accredited laboratory upon receipt of the samples and 1-hour TSP level will be performed in-situ.

- 3.1.6 High volume samplers (HVS - Model GS-2310 Accu-vol) complete with the appropriate sampling inlets were installed for 24-hour TSP sampling. The HVS is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50 Appendix B). A portable dust meter was used for the 1-hour TSP monitoring. Table 3.4 summarises the equipment used.

Table 3.4 Air Quality Monitoring Equipment

Equipment	Model
HVS Sampler	GS 2310 Accu-vol system
Calibrator	GMW 25
1-hour TSP Dust Meter	Laser Dust Monitor – Model LD-1 (L)

Monitoring Methodology and Calibration Details

24-hour TSP Monitoring

(i) Field Monitoring, Operation & Analytical Procedures

- 3.1.7 Operating/analytical procedures for the operation of HVS are as follows. The sampler was placed on a horizontal platform with appropriate supporting structure such that:
- the filter was at least 1.3 meters above ground;
 - no two samplers were placed less than 2 metres apart;
 - the distance between the sampler and an obstacle, such as buildings, were at least twice the height that the obstacle protrudes above the sampler;
 - a minimum of 2 metres separation from walls, parapets and penthouses were required for the rooftop samplers;
 - a minimum of 2 metres separation from any supporting structure, measured horizontally was provided;
 - airflow around the sampler was unrestricted;
 - no furnaces or incineration flues were operating near the sampler;
 - the sampler was more than 20 metres from the dripline; and
 - any wire fence and gate to protect the sampler, did not cause any obstruction during monitoring.
- 3.1.8 Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 1.1 m³/min. and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50.
- 3.1.9 For TSP sampling, fibreglass filters (G810) were used [Note: these filters have a collection efficiency of > 99% for particles of 0.3 mm diameter].
- 3.1.10 The power supply was checked to ensure the sampler worked properly.
- 3.1.11 On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air monitoring station.
- 3.1.12 The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.

- 3.1.13 The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- 3.1.14 The shelter lid was closed and secured with the aluminum strip.
- 3.1.15 The timer was then programmed. Information was recorded on the record sheeting, which included the starting time, the weather condition, and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- 3.1.16 After sampling, the filter was transferred from the filter holder of the HVS to a sealable plastic bag and sent to the laboratory for weighing. The elapsed time was also recorded.
- 3.1.17 Before weighing, all filters were conditioned for 24 hours before weighing under temperature of $25^{\circ}\text{C} \pm 3^{\circ}\text{C}$ and the relative humidity (RH) $< 50\% \pm 5\%$, preferably 40%. The HOKLAS laboratory (ALS Technichem (HK) Pty Ltd) has comprehensive quality assurance and quality control programmes.

(ii) Maintenance

- 3.1.18 Proper maintenance would be provided for the HVS as described below:
- 3.1.19 The HVS motors and their accessories have been properly maintained. Appropriate maintenance such as routine motor brushes replacement (time interval for replacement is about 500 hours) and electrical wiring checking have been conducted to ensure that the equipment and necessary power supply were in good working condition.
- 3.1.20 Initial calibration of HVS was conducted upon installation of equipment. The subsequent calibration would be provided at 2-month intervals using GMW-25 Calibration Kit.

1-hour TSP Monitoring

(i) Measuring Procedures

- 3.1.21 The measuring procedures of the 1-hour dust meter have been in accordance with the Manufacturer's Instruction Manual as follows:
- Set POWER to "ON", push BATTERY button, make sure that the meter's indicator is in the range with a red line and allow the instrument to stand for about 3 minutes (Then, the air sampling inlet has been capped).
 - Push the knob at MEASURE position.
 - Push "O-ADJ" button. (Then meter's indication is 0).
 - Push the knob at SENSI ADJ position and set the meter's indication to S value described on the Test Report using the trimmer for SENSI ADJ.
 - Pull out the knob and return it to MEASURE position.
 - Push "START" button.
 - All measurement procedures in section 2.3 of the approved EM&A Manual are followed during the reporting period.

(ii) Maintenance

- 3.1.22 The 1-hour TSP meter would be checked at 3 month intervals and calibrated at 1-year intervals throughout all stages of the air quality baseline monitoring.

Event and Action Plans

3.1.23 The Event and Action Plan (EAP) for air quality monitoring is presented in **Annex C**.

3.2 Water Quality

Monitoring Requirement

3.2.1 Water quality monitoring was conducted in accordance with the EM&A Manual. Tables 3.5 & 3.6 show the established Action/Limit Levels for the water environmental monitoring parameters.

Table 3.5 Derived Summaries of Action and Limit Levels for Marine Water Quality

Parameters	Location	Action	Location	Limit
DO (Surface & Middle)	FCZ	6.0 mg/L	FCZ	5.3 mg/L
	All except FCZ	4.9 mg/L	All except FCZ	4.6 mg/L
DO (Bottom)	All	3.7 mg/L	All	3.4 mg/L
pH (depth-averaged)		N/A	All	6.5 - 8.5
SS (Depth-averaged)☆	FCZ	4.5 mg/L	FCZ	5.6 mg/L
	All except FCZ	6.1 mg/L	All except FCZ	10.6 mg/L
SS (Depth-averaged) Dredging for submarine pipelines⊕	M_RO1	6.1 mg/L	M_RO1	10.6 mg/L
Turbidity (Tby) (depth-averaged) ☆	FCZ	2.9 NTU☼	FCZ	3.9 NTU☼
	All except FCZ	3.3 NTU☼	All except FCZ	6.2 NTU☼
Ammonia Nitrogen (depth-averaged)	FCZ	0.02 mg/L	FCZ	0.03 mg/L
	All except FCZ	0.05 mg/L Δ	All except FCZ	0.05 mg/L Δ
Nitrate Nitrogen (depth-averaged)	FCZ	0.08 mg/L	FCZ	0.09 mg/L
	All except FCZ	0.09mg/L Δ	All except FCZ	0.09 mg/L Δ
Nitrite Nitrogen (depth-averaged)	FCZ	0.02 mg/L θ	FCZ	0.02 mg/L θ
	All except FCZ	0.02 mg/L	All except FCZ	0.04 mg/L
TIN (depth-averaged)	FCZ	0.12 mg/L	FCZ	0.14 mg/L
	All except FCZ	0.16 mg/L	All except FCZ	0.18 mg/L
Total Phosphorus (depth-averaged)	All	0.09 mg/L Δ	All	0.09 mg/L Δ

Remarks:

☆ : Action and limit levels are subjected to review especially for wet season throughout the construction phase of the project.

⊕ : Action and limit levels are subjected to review before the dredging works.

☼ : All are based on EM&A baseline monitoring data due to marked difference between EPD turbidity data and those from the baseline survey.

Δ : For nutrient monitoring (except NO₂-N) at non-FCZ stations, the trigger level has made reference to the existing golf course guideline values. The guideline value of NO₂-N is below the current detection limit of 0.01mg/L and thus not used.

θ : The same action and limit level of 0.02 mg/L is determined from the EM&A baseline data as 78% of the NO₂-N data are ≤ 0.01 mg/L and all remaining 22% equal to 0.02 mg/L.

FCZ including fish culture zones of Kai Lung Wan, Tai Tau Chau and Kau Sai

All except FCZ including remaining impact monitoring station of M_RO1, M_Marsh, M_BP and M_Coral.

Control monitoring locations: M_A & M_B

Table 3.6 Derived Summaries of Action and Limit Levels for Freshwater Water Quality

Parameters	Location	Action	Location	Limit
DO (mid-depth)		6.3 mg/L	All	4 mg/L ξ
pH (mid-depth)		N/A	All	6.0 - 9.0
SS (mid-depth) ☆	All	3.8 mg/L or 120% of upstream control station's SS at the same tide of the same day	All	8 mg/L or 130% of upstream control station's SS at the same tide of the same day
Turbidity (Tby) (mid-depth) ☆	All	3.1 NTU or 120% of upstream control station's Tby at the same tide of the same day	All	4 NTU or 130% of upstream control station's Tby at the same tide of the same day
Ammonia Nitrogen (mid-depth)		N/A	All	0.01 mg/L
Nitrate Nitrogen (mid-depth)	All	0.10 mg/L	All	0.11 mg/L
Nitrite Nitrogen (mid-depth)		N/A	All	0.01 mg/L
TIN (mid-depth)	All	0.12 mg/L	All	0.13 mg/L
Total Phosphorus (mid-depth)		N/A	All	0.02 mg/L

Remarks:

☆ : Action and limit levels are subjected to review especially for wet season.

Freshwater monitoring locations: F_UA, F_DA, F_UB, F_DB, F_UC, F_DC and F_Inland Marsh

As most of the freshwater samples were reported of NH₃-N, NO₂-N levels below the detection limit of 0.01 mg/L, limit level is set at 0.01 mg/L. Similarly for TP, a limit level of 0.02 mg/L (the detection limit of TP) is imposed.

ξ : Water Quality Objectives of the Port Shelter

Monitoring Parameters, Frequency and Programme

- 3.2.2 For marine water quality, measurements shall be taken at both mid-flood and mid-ebb tides and at three water depths (1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth is less than 6 m, in which case the mid-depth station may be omitted). Should the water depth be less than 3 m, only the mid-depth station will be monitored.
- 3.2.3 For the stream course, measurements shall be taken at mid-water depth.
- 3.2.4 The water quality parameters which need to be monitored are as follows:

- Marine water quality - dissolved oxygen (DO), temperature, turbidity, suspended solids (SS), pH and salinity
 - Freshwater water quality - dissolved oxygen (DO), temperature, turbidity, suspended solids (SS), pH and salinity
- 3.2.5 Additional marine and freshwater water quality monitoring parameters for the impact monitoring during construction include nitrate nitrogen (NO₃-N), nitrite nitrogen (NO₂-N), ammonia nitrogen (NH₃-N), total phosphate (TP) and selected pesticides.
- 3.2.6 The ET Leader shall propose the additional monitoring parameters for approval by IC(E), Engineer, EPD and AFCD, and shall submit such information for approval at least 2 weeks before the turf establishment period.
- 3.2.7 Additional water quality monitoring at Tai Tau Chau FCZ (TTC), Kai Lung Wan FCZ (KLW), Kau Sai FCZ (KS), downstream of the existing marsh (M_Marsh), marine water of Port Shelter (M_Coral), existing reservoir (F_Inland M) and Control stations (M_A and M_B) shall be carried out after heavy rain storm or when there is an overflow event from the reservoir, irrigation buffer lake or detention ponds/tanks. The heavy rain storm shall be defined when there is an amber/red/black rainstorm warning signal issued by the Hong Kong Observatory. The water sample shall be taken within 24 hours after the black/red/amber rainstorm warning signal is cancelled. Please refer to revised EM&A manual for the sampling condition requirement after a heavy rain storm event occurs. The monitoring parameters shall include dissolved oxygen, temperature, turbidity, suspended solids, pH and salinity. Additional parameters shall be the same as stated in paragraphs 3.2.5-3.2.6.

Monitoring Frequency

- 3.2.8 The monitoring parameters and frequency are summarized in Table 3.7. The monitoring programme for the reporting period is shown in **Annex B**.

Table 3.7 Water Quality Monitoring Parameter, Frequency and Locations

Parameters	Frequency	Location
Dissolved Oxygen (mg/L)	3 days per week	<u>Marine Water</u> Fish culture zone stations: TTC, KLW, KS Control stations: M_A, M_B Impact stations: M_BP, M_RO1, M_Marsh, M_Coral <u>Freshwater Water</u> Stream A (F_UA, F_DA) Stream B (F_UB, F_DB) Stream C (F_UC, F_DC) Inland Marsh (F_Inland_M)
Temperature (°C)		
Turbidity (NTU)		
pH		
Salinity (ppt)		
Suspended Solids (mg/L)		

Monitoring Locations

3.2.9 The water quality monitoring locations for marine and freshwater (**Figure 3.2**) are summarized in Table 3.8.

Table 3.8 Water Quality Monitoring Locations during Construction Phase

Identification Number	Location	Co-ordinates		Approx. Water Depth	No. of Depth
		latitude	longitude		
<i>Marine Water (9 stations)</i>					
TTC	Tai Tau Chau Fish Culture Zone	22° 22' 03.7"	114° 19' 19.6"	9.5 m	3
KLW	Kai Lung Wan Fish Culture Zone	22° 22' 10.6"	114° 18' 01.4"	13 m	3
KS	Kau Sai Fish Culture Zone	22° 20' 26.5"	114° 18' 59.9"	11 m	3
M_BP	Temporary barging point	22° 21' 50.6"	114° 19' 16.7"	9.6 m	3
M_RO1	Desalination plant south of the existing pier	22° 21' 51.8"	114° 18' 17.7"	5 m	2
M_Marsh	Discharge point at the existing marsh	22° 22' 19.8"	114° 19' 05.4"	7.7 m	3
M_Coral	Marine water of Port Shelter	22° 21' 21.3"	114° 19' 42.7"	10.2m	3
M_A	Water Control Station of Port Shelter	22° 22' 51.3"	114° 18' 34.5"	7.5 m	3
M_B	Water Control Station of Port Shelter	22° 20' 26.4"	114° 20' 11.8"	16.5 m	3
<i>Fresh Water (7 stations)</i>					
F_UA	Upstream and downstream of stream A	22° 21' 32.3"	114° 19' 06.5"	-	1
F_DA		22° 21' 33.5"	114° 19' 06.8"		1
F_UB	Upstream and downstream of stream B	22° 21' 23.9"	114° 19' 16.1"	-	1
F_DB		22° 21' 27.2"	114° 19' 16.0"		1
F_UC	Upstream and downstream of stream C	22° 21' 14.8"	114° 19' 26.4"	-	1
F_DC		22° 21' 03.5"	114° 19' 32.0"		1
F_Inland M	Downstream of the existing marsh (Inland)	22° 22' 17.9"	114° 18' 59.1"	-	1

Monitoring Equipment

3.2.10 The equipment listed below shall be supplied by the ET and approved by the IC(E) and the Engineer for water quality monitoring.

Dissolved Oxygen and Temperature Measuring Equipment

3.2.11 The instrument shall be a portable and weatherproof DO measuring instrument complete with cable and sensor, and use a DC power source. The equipment shall be capable of measuring:

- dissolved oxygen levels in the range of 0 - 20 mg L⁻¹ and 0 - 200% saturation; and
- a temperature of 0 - 45 degrees Celsius.

3.2.12 It shall have a membrane electrode with automatic temperature compensation complete with a cable. Sufficient stocks of spare electrodes and cables shall be available for replacement where

necessary. (For example, YSI model 59 meter, YSI 5739 probe, YSI 5795A submersible stirrer with reel and cable or an approved similar instrument).

- 3.2.13 Should salinity compensation not be built-in in the DO equipment, in-situ salinity shall be measured to calibrate the DO equipment prior to each DO measurement.

Turbidity Measurement Instrument

- 3.2.14 Turbidity shall be measured in situ by the nephelometric method. The instrument shall be portable and weatherproof turbidity measuring instrument using a DC power source complete with cable, sensor and comprehensive operation manuals. It shall have a photoelectric sensor capable of measuring turbidity between 0 - 1000 NTU (for example, Hach model 2100P or an approved similar instrument). The cable shall not be less than 25m in length. The meter shall be calibrated in order to establish the relationship between NTU units and the levels of suspended solids.

Suspended Solids

- 3.2.15 A water sample at least 2.5L in capacity with messenger and using a 10m line should be collected. Samples should be submitted to HOKLAS accredited laboratory as soon as possible for gravimetric analysis for suspended.

Sampler

- 3.2.16 A water sampler is required. It shall comprise a transparent PVC cylinder, with a capacity of not less than 2 litres, which can be effectively sealed with latex cups at both ends. The sampler shall have a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler is at the selected water depth (for example, Kahlsico Water Sampler or an approved similar instrument).

Water Depth Detector

- 3.2.17 A portable, battery-operated echo sounder shall be used for the determination of water depth at each designated monitoring station. This unit can either be hand held or affixed to the bottom of the work boat, if the same vessel is to be used throughout the monitoring programme.

Salinity

- 3.2.18 A portable salinometer capable of measuring salinity in the range of 0 - 40 parts per thousand (ppt) shall be provided for measuring salinity of the water at each monitoring location.

pH

- 3.2.19 The instrument shall consist of a potentiometer, a glass electrode, a reference electrode and a temperature-compensating device. It shall be readable to 0.1pH in a range of 0 to 14. Standard buffer solutions of at least pH 7 and pH 10 shall be used for calibration of the instrument before and after use. Details of the method shall comply with APHA, 19th ed. 4500-HTB.

Flow Rate Meter

- 3.2.20 A portable, battery-operated flow meter should be used for the determination of water depth at each designated monitoring location and record in m³/s. A hand held or meter fixed to the underside of the survey boat may be used.

Sample Containers and Storage

- 3.2.21 Water samples for laboratory analysis shall be stored in high density polythene bottles with no preservative added, packed in ice (cooled to 4°C without being frozen) and delivered to the laboratory and analysed as soon as possible after collection. Sufficient volume of samples shall be collected to achieve the required detection limit.

Monitoring Position Equipment

- 3.2.22 A hand-held or boat-fixed type digital Differential Global Positioning System (DGPS) with way point bearing indication or other equipment instrument of similar accuracy, shall be provided and used during marine water monitoring to ensure the monitoring vessel is at the correct location before taking measurements.

Monitoring Methodology and Calibration Details

- 3.2.23 Dissolved oxygen (DO), temperature, turbidity, pH and salinity were measured in situ at the designated water quality monitoring stations. General observation, weather conditions, with the sampling time, date and location were marked on the field record sheet.
- 3.2.24 Water samples were taken from each monitoring station for laboratory analysis. The sample identification number, sampling location, date, time, project name and analyses were required.
- 3.2.25 The samples were placed in a cooler with ice (to 4°C without being frozen) and kept away from sunlight. Samples were submitted to a Hong Kong Laboratory Accreditation Scheme (HOKLAS) or other international accredited laboratory for analysis within 24 hours of sampling.

Calibration of In-Situ Instruments

- 3.2.26 All in situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use and subsequently re-calibrated at three monthly intervals throughout all stages of the water quality monitoring programme. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter were carried out before measurement at each monitoring location.

Laboratory Analysis

- 3.2.27 All laboratory work were carried out by ALS Technichem Pty Ltd (HOKLAS accredited laboratory). Water samples were collected at the monitoring and control stations for carrying out the laboratory determinations. The determination work will start within 24 hours after collection of the water samples. The analysis shall follow the standard methods according to APHA Standard Methods for the Examination of Water and Wastewater, 19th Edition, or an equivalent method approved by EPD.

Table 3.9 Analytical Methods to be applied to Water Quality Samples

Determinant	Standard Method	Reporting Limit
Suspended Solids	APHA 2540 D	2 mg/L
Nitrate Nitrogen	APHA 4500-NO ₃ ⁻	0.01 mg/L
Nitrite Nitrogen	APHA 4500-NO ₂ ⁻	0.01 mg/L
Ammonia Nitrogen	APHA 4500-NH ₃ (D)	0.01 mg/L
Total phosphorus	ASTM D515-88B	0.02 mg/L*
Chlorophyll a	APHA 10200 H2 &3	0.5 µg/L

Remarks: *After review baseline data, the detection limit report will be revised to 0.02 mg/L.

QA/QC Procedure

- 3.2.28 ALS Technichem Pty Ltd. has comprehensive quality assurance and quality control programmes. For QA/QC procedures of parameters, one duplicate sample was analysed for every batch of 20 samples as required by HOKLAS.

Event and Action Plans

- 3.2.29 The Event and Action Plan (EAP) for water quality monitoring is presented in **Annex C**.

3.3 Ecology

Introduction

- 3.3.1 The marine and terrestrial ecological monitoring surveys for the ecological EM&A were conducted in accordance with the EM&A manual.
- 3.3.2 As stipulated in the EM&A Manual, the ecological monitoring surveys for terrestrial ecology would be conducted monthly during the construction phase. Monitoring survey would consist of aquatic fauna survey. While the majority of the Project Area would be subject to site formation, natural streams would be partially or fully preserved and protected by buffer zones, and therefore would constitute the primary target of the terrestrial ecological monitoring. Special attention should thus be paid to ecologically sensitive streams to ensure minimum damage to existing vegetation and streams. The purpose of the monitoring survey was to check the conditions of the stream habitat and the associated aquatic fauna communities.
- 3.3.3 While the ecological monitoring surveys for marine ecology included coral monitoring at both the eastern and western coasts of Kau Sai Chau Island. The coral monitoring at the western coast would be conducted concurrently with the dredging works which have yet to conduct, and therefore had not been commenced. The coral monitoring at the eastern Kau Sau Chau would be monthly for the first three months of the construction phase, and if no exceedance was recorded, the monitoring schedule would be changed to quarterly during the rest of the construction phase. As a coral damage incident was recorded in March 2006, the monthly monitoring was extended for another three months from April 2006 to June 2006. No exceedance was recorded during these three months, the monitoring schedule were changed to quarterly after that till the end of the construction phase. Monitoring survey would consist of checking tagged corals at both impact sites and control site. The purpose of the monitoring survey was to check the conditions of the tagged corals and the impact sites. Although the dredging works for the desalination plant have yet to conduct, 89 natural corals near the plant were transplanted in November 2006. The transplanted corals would be monitored quarterly for a year.

Ecological Mitigation Measures and Implementations

- 3.3.4 Ecological mitigation measures to be implemented during the construction phase include the following:
- Establishment of buffer zones for the natural stream courses during both construction phase.
 - Provision of temporary bypass channels or pipes during construction phase for stream courses subject to pipe culverting.
 - Protection of water quality of the natural stream courses and temporary bypass channels or pipes.

- Transplantation of coral colonies within the dredging area for the desalination plant prior to the dredging works.
- Avoidance of corals when the anchoring points are deployed, and to shift the floating temporary barging point to the location with least corals within the mapping area.
- Regular site audit of ecological mitigation measures and good site practice.

Monitoring Frequency and Schedule

Terrestrial Ecology

- 3.3.5 As reported in the EIA Report, there were four perennial natural streams (Streams A-D) within the Assessment Area for the EIA Study. Streams A, B & C were located within the Project Area, while Stream D was outside the Project Areas and acted as the main stream draining the western part of the Assessment Area. Buffer Zone would be established for the three streams within the Project Area along their partial length (Stream A) or full length (Streams B & C) (**Figure 3.3**). Moreover, Streams B, C & D would be monitored for aquatic fauna monthly during the construction phase. Monitoring on the implementation of the mitigation measures for stream protection, the effectiveness of stream buffer zones, and the aquatic fauna in streams would be conducted during the entire construction phase.
- 3.3.6 The objectives of the monitoring survey are to check the status of *Caridina trifasciata* and *Nanhaipotamon hongkongensis*. The surveys covered natural stream courses within the assessment area (Streams A to D), and aquatic fauna were studied by various sampling methods depending upon site conditions. Methods included direct observation, active searching, and sample collection using hand-nets. Hand nets were used to collect swimming organisms such as shrimps and fish. Where necessary boulders on the stream beds were overturned to locate aquatic organisms such as crabs. Aquatic species encountered was recorded, with special attention to rare or protected species.

Marine Ecology

- 3.3.7 As required in the EM&A Manual, prior to the commencement of all construction works, a baseline survey of natural corals were conducted in December 2005. At each of the Site C, Site B2, Site D2 and a Control Site near the AFCD's Coral Buoy at Sharp Island (**Figure 3.4**), 20 natural coral colonies in good conditions (i.e. generally intact and no sign of bleaching) and significant sizes (preferably over 20 cm in diameter) were selected and tagged. Each of the tagged coral colonies was identified to species level and their conditions, in terms of percentages of survival, sedimentation and bleaching, were recorded. Each coral was attached with a plastic label with assigned number and then photographed. The species and the size of each tagged corals were also recorded. The species of corals to have been tagged included the following 15 species: *Cyphastrea serailia*, *Favia speciosa*, *Favites abdita*, *Favites pentagona*, *Goniastrea aspera*, *Goniopora columna*, *Hydnophora exesa*, *Leptastrea pruinosa*, *Lithophyllon undulatum*, *Pavona decussata*, *Platygyra acuta*, *Platygyra carnosus*, *Plesiastrea versipora*, *Psammocora superficialis*, and *Turbinaria peltata*. All tagged corals were in good conditions during the baseline survey, without significant sign of bleaching or being covered by sediments, and therefore were all recommended as the monitored coral colonies (all 80 tagged corals, 20 from each site). The seagrass beds in Site D3 were also surveyed for their extent, coverage percentage and health conditions during the baseline survey. The results of the baseline survey were presented in the Baseline Report. The original 20 tagged corals at Site B2 were re-organised in April 2006, with B-11 to B-20 retained, but 40 new tagged corals (B-21 to B-60) were established. The number of tagged corals at Site B2 was therefore increased from 20 nos. to 50 nos. The baseline conditions of these newly tagged corals (40 nos.) were presented in the monitoring Report for April 2006.

- 3.3.8 The reporting month (September 2007) was the Month 21 of the construction programme. As the dredging works for the desalination plant had not been commenced, the impact sites to be monitored in this monitoring survey were Site B2 and Site C (impact sites on the eastern Kau Sai Chau Island for the new golf course) only, while Site D2 and Site D3 (impact sites on the western Kau Sai Chau Island for desalination plant) were not required in this survey. The coral transplantation, which should be conducted prior to the commencement of dredging works, however were conducted in November 2006. The monitoring on transplanted corals on the bedrock at Site D2 (see **Figure 3.5**) therefore was performed in this survey. 89 natural corals were transplanted and each was assigned with a number. These corals would be monitored quarterly for a year after transplantation, and the first monitoring was performed in December 2006. The baseline conditions of the transplanted corals had been recorded during the transplantation and were checked during the monitoring. With the first monitoring in December 2006, the second monitoring in March 2007, and the third monitoring in July 2007, the fourth monitoring (also the final one) was conducted in the reporting month.
- 3.3.9 The schedule for the impact sites on the eastern Kau Sai Chau Island during construction would be monthly in the first three months of the construction programme, and if no exceedance was recorded then quarterly till the end of the construction. As coral damage incident was reported in Month Three of the construction programme, AFCD requested the monthly monitoring should be extended to cover another three months (April, May and June 2006). No exceedance was recorded during the extended three-month period and the schedule were change to quarterly. The present survey was the eleventh monitoring survey (the fifth quarterly survey on the eastern Kau Sai Chau Island). The survival and health conditions of the coral colonies were recorded.
- 3.3.10 During the weekly site inspection, ET also monitored and audited the implementation of the recommended mitigation measures for terrestrial and marine ecology. Monitoring locations for ecology are shown in **Figures 3.3 – 3.5**. The monitoring programme for the reporting period is shown in **Annex B**.

Event and Action Plans

- 3.3.11 The Event and Action Plan (EAP) for ecology monitoring is presented in **Annex C**.

3.4 Landscape and Visual

- 3.4.1 The EIA concluded that the landscape and visual impacts associated with the construction of the third golf course are anticipated to be acceptable with mitigation. In order to ensure that the effective management and implementation of landscape mitigation measures developed and defined in the EIA, the ET conducted regular site inspections of the construction work sites.
- 3.4.2 Auditing inspections and reporting are undertaken once every two weeks of the construction phase. The effectiveness of the mitigation works has been audited in order to ensure impact reduction levels are achieved as described in the EIA report for this monitoring month. The monitoring programme for the reporting period is shown in **Annex B**.

3.5 Archaeology (Watching Brief)

Introduction

- 3.5.1 The archeological impact assessment conducted in the EIA concluded that some potential for archaeological material remains at the Wan Chai Archaeological Site and a watching brief is recommended during the construction phase.

- 3.5.2 A watching brief is a process whereby a qualified and licensed archaeologist monitors the excavation works during the construction phase in areas identified (and agreed with the Antiquities and Monuments Office (AMO)) to be of archaeological potential.
- 3.5.3 The archaeologist conducting the watching brief should obtain a licence prior to commencement of works as stipulated in Section 12 of the Antiquities and Monuments Ordinance (Cap. 53). The licence was granted on 22nd December 2005.

Monitoring Location

- 3.5.4 The monitoring locations include Hole 2, Hole 11, Hole 12, Hole 14, Hole 15 & Hole 16. The monitoring locations are present in **Figure 3.6**.

Monitoring Frequency

- 3.5.5 A total of 18 days of monitoring is considered as minimum, and additional arrangement for watching brief should be made in consultation with AMO in case significant archaeological findings are unearthed in the course of excavation work.

Progress Report

- 3.5.6 Archaeologist should submit progress reports every 3 months during the programme of the watching brief.
- 3.5.7 A summary table for categories of archaeological find and recommended action is presented in **Annex C**.

3.6 Land Contamination

Potential Areas Recommended for Further Investigation

- 3.6.1 Contamination Assessment Plan (CAP) shall be submitted to EPD for approval before site investigation. If land contamination is confirmed by the site investigation, submission of a Remediation Assessment Plan (RAP) including a Contamination Assessment Report (CAR) is required. Potential 5 land contamination hotspots are presented in **Figure 3.7**.

4. Implementation Status on Environmental Protection Requirements

- 4.1.1 Major construction work of the third golf course were (i) turfing at Holes 3-8, 10-16 and 18 (ii) sand capping at Holes 10 and 18 (southern part) (iii) permanent drainage / irrigation system / sub-soil drainage installation at central part (Holes 1 and 10) of East Course, (iv) permanent closed low flow drainage system installation, (v) hydroseeding at the permanent slope/bare grounds and (vi) furnishing work at permanent bridges.
- 4.1.2 The Contractor was reminded to provide sufficient dust suppression measures for loading/unloading activities, rough shaping and haul road (truck traffic).
- 4.1.3 Implementation of temporary drains on site was not according to the general principles of TDMP. In addition, the water quality results at all identified streams and fresh water inland marsh revealed that improvement and strengthen of temporary drainage system installed on site is required after heavy rains.
- 4.1.4 Hydroseeding at scar areas within the East Course was completed before March 2007. However, some areas were required re-hydroseeding (due to soil erosion after rain and died out) and will be planted with native shrub. Construction waste stockpiles were temporary stored and accumulated at Hole 2 near the adjacent slope of concrete batching plant during this reporting month. The stockpile location was considered improper. The Contractor was reminded to relocate the construction waste or dispose more frequently off-site and to submit the trip tickets record for our record.
- 4.1.5 Disposal of temporary stored wastewater from the CHEC's temporary sewage treatment plant was carried out on 9th September 2007 by licenced Contractor. However, no water quality report was submitted by CHEC regarding the performance of the sewage treatment plant. Therefore, no discharge of sewage effluent from the sewage treatment plant to fresh water inland marsh is allowed. The Contractor was continuously reminded to submit the disposal record by the licenced Contractor for record.
- 4.1.6 Insufficient mobile toilets were available on site at remote areas, only few units were located at the southern portion of construction site and were in dirty condition. The Contractor was reminded to keep the mobile toilets in clean condition.
- 4.1.7 No dredging work has been carried out near to the existing pier for the desalination plant pipelines. Summary of implementation status is provided in **Annex D**.

5. Monitoring Results

5.1 Air Quality

5.1.1 Dust monitoring was conducted as scheduled in the reporting month. Monitoring of air quality was conducted on 6 occasions in 25th August to 24th September 2007. All monitoring data are provided in **Annex E**. Monitoring of 24-hour TSP was conducted at GCA B1 on 25th, 31st August, 6th, 12th, 18th and 24th September 2007. The QA/QC results for laboratory testing in the reporting month were acceptable. The QA/QC results are summarised in **Annex F**.

5.1.2 No exceedance of 24-hour TSP was recorded at GCA B1 during this reporting month.

5.2 Water Quality

5.2.1 Marine and freshwater water quality monitoring were conducted at the 9 and 7 designated monitoring stations respectively. All monitoring data are provided in **Annex E**.

5.2.2 Monitoring of marine and freshwater locations was conducted on 4 occasions in August to September 2007 (27th August, 3rd, 10th and 17th September 2007). The QA/QC results for laboratory testing in the reporting month were acceptable. The QA/QC results are summarised in **Annex F**. No rainstorm signal was hoisted during this reporting month.

5.2.3 Turf establishment progress is shown as follows:

- Hole 8 – February 2007 (Tee, fairway and green);
- Hole 5 – March 2007 (Tee, fairway and green);
- Hole 4 – April 2007 (Tee, fairway and green);
- Hole 6 – May 2007 (Tee, fairway and green);
- Hole 7 – June 2007 (Tee, fairway and green);
- Hole 3 – June 2007 (Tee, fairway and green);
- Hole 11 – June 2007 (Tee, fairway, except green);
- Hole 18 – July 2007 (Tee, fairway, except green);
- Hole 15 – July 2007 (Tee, fairway and green)
- Hole 11 – July 2007 (Green)
- Hole 13 – August 2007 (Tee, fairway, except green)
- Hole 14 – August 2007 (Tee, fairway, except green)
- Hole 16 – August 2007 (Tee, fairway, except green)
- Hole 12 – September 2007 (Tee, fairway and green)
- Hole 10 – September 2007 (Tee, fairway and green)

(Planting at Holes 10 and 12 will be commenced at next reporting month)

5.2.4 Additional water quality parameters include NH₃-N, NO₃-N, NO₂-N, TIN, TP and Chlorophyll a. Monitoring locations for the additional parameters include F_A since from this reporting month.

5.2.5 Chemical applications were applied at the Holes 3-8, 11, 13-16 and 18 during the reporting month. They are approved insecticides listed in the turfgrass management plan in the final EIA report. Water samples were required to send to overseas laboratory for analysis and testing.

Marine water

- M_RO1: (i) one action level exceedance of suspended solid;
- KLW: (i) one action level exceedance of suspended solid;
- M_Marsh: (i) one action level exceedance of turbidity and (ii) one limit level exceedance of chlorophyll a;
- TTC: (i) one action level exceedance of turbidity, (ii) one action level exceedance of suspended solid, (iii) one limit level exceedance of ammonia nitrogen and (iv) two limit level exceedances of chlorophyll a;
- M_BP: (i) one action level exceedance of suspended solid; and
- KS: (i) one action level exceedance of suspended solid and (ii) one limit level exceedance of ammonia nitrogen.

5.2.6 The marine water exceedances were summarised in **Table 5.2-1**.

Table 5.2-1 Marine water Exceedance Summary August to September 2007

Monitoring Station	Exceedance Level	Date	Parameters	Project-related
M_RO1	Action Level	10 th Sep 07	SS	No
KLW	Action Level	10 th Sep 07	SS	No
M_Marsh	Action Level	17 th Sep 07	Turbidity	No
	Limit Level	17 th Sep 07	Chl a	No
TTC	Action Level	27 th Aug 07	Turbidity	No
	Limit Level	3 rd Sep 07	NH ₃ -N	No
	Action Level	10 th Sep 07	SS	No
M_BP	Limit Level	10 th Sep 07	Chl a	No
	Limit Level	17 th Sep 07	Chl a	No
	Action Level	10 th Sep 07	SS	No
KS	Limit Level	3 rd Sep 07	NH ₃ -N	No
	Action Level	10 th Sep 07	SS	No

Remarks: Exceedances were mainly due to natural variation / rainstorm events of the marine water.

5.2.7 During non-rainy days, the range of the suspended solids, turbidity, ammonia nitrogen, chlorophyll a and total inorganic nitrogen measured at the Control Station (M_A) was in the same order of magnitude at various marine monitoring stations including M_Marsh, TTC, M_BP and KS. There is no significant difference of the measured concentrations between control station and impact stations and the exceedances were considered not project-related.

Freshwater

- Stream A: (i) two limit level exceedances of ammonia nitrogen, (ii) one limit level exceedance of total inorganic nitrogen and (iii) one limit level exceedance of chlorophyll a.
- Stream B: (i) one action and six limit level exceedances of turbidity, (ii) five action and one limit level exceedances of suspended solids, (iii) one limit level exceedance of ammonia nitrogen, (iv) one action and two limit level exceedances of nitrate nitrogen, (v) one action and two limit level exceedances of total inorganic nitrogen and (vi) one action and five limit level exceedances of chlorophyll a.
- Stream C: (i) two action and three limit level exceedances of turbidity, (ii) four action and one limit level exceedances of suspended solids, (iii) one limit level exceedances of ammonia nitrogen, (iv) five limit level exceedances of nitrate nitrogen, (v) six limit level exceedances of total inorganic nitrogen and (vi) one action and three limit level exceedances of chlorophyll a.

- Fresh Water Inland Marsh: (i) one limit level exceedance of ammonia nitrogen, (ii) three limit level exceedances of nitrate nitrogen, (iii) four limit level exceedances of total inorganic nitrogen and (iv) one limit level exceedance of chlorophyll a.

5.2.8 The freshwater water exceedances were summarised in **Table 5.2-2**.

Table 5.2-2 Freshwater Exceedance Summary August to September 2007

Monitoring Station	Exceedance Level	Date	Parameters	Project-related
F_DA	Limit Level	3 rd Sep 07	NH3-N, TIN, Chl a	No
	Limit Level	17 th Sep 07	NH3-N	No
F_UB	Limit Level	27 th Aug 07	Turbidity	Yes
	Action Level	3 rd Sep 07	SS	Yes
	Action Level	3 rd Sep 07	Chl a	No
	Limit Level	3 rd Sep 07	Turbidity	Yes
	Limit Level	10 th Sep 07	Chl a	No
	Action Level	17 th Sep 07	Turbidity, SS	Yes
F_DB	Action Level	27 th Aug 07	SS	Yes
	Limit Level	27 th Aug 07	Turbidity	Yes
	Limit Level	27 th Aug 07	NO3-N, TIN, Chl a	No
	Action Level	3 rd Sep 07	SS	Yes
	Limit Level	3 rd Sep 07	Turbidity	Yes
	Limit Level	3 rd Sep 07	NH3-N, NO3-N, TIN, Chl a	No
	Limit Level	10 th Sep 07	Turbidity, SS	Yes
	Limit Level	10 th Sep 07	Chl a	No
	Action Level	17 th Sep 07	SS	Yes
	Action Level	17 th Sep 07	NO3-N, TIN	No
	Limit Level	17 th Sep 07	Turbidity	Yes
	Limit Level	17 th Sep 07	Chl a	No
F_UC	Limit Level	3 rd Sep 07	NH3-N, TIN	No
	Action Level	10 th Sep 07	Chl a	No
	Limit Level	10 th Sep 07	Turbidity, SS	Yes
	Action Level	17 th Sep 07	SS	Yes
	Limit Level	17 th Sep 07	Turbidity	Yes
	Limit Level	17 th Sep 07	NO3-N, TIN, Chl a	No
F_DC	Action Level	27 th Aug 07	Turbidity, SS	Yes
	Limit Level	27 th Aug 07	NO3-N, TIN	No
	Action Level	3 rd Sep 07	SS	Yes
	Limit Level	3 rd Sep 07	Turbidity	Yes
	Limit Level	3 rd Sep 07	NO3-N, TIN	No
	Action Level	10 th Sep 07	Turbidity, SS	Yes
	Limit Level	10 th Sep 07	NO3-N, TIN, Chl a	No
	Limit Level	17 th Sep 07	NO3-N, TIN, Chl a	No
F_Inland M	Limit Level	27 th Aug 07	NO3-N, TIN	No
	Limit Level	3 rd Sep 07	NO3-N, TIN, Chl a	No
	Limit Level	10 th Sep 07	NO3-N, TIN	No
	Limit Level	17 th Sep 07	NH3-N, TIN	No

Remarks:

Exceedances of turbidity and suspended soil recorded at the Streams A, B, C and the Fresh Water Inland Marsh were mainly due to insufficient temporary drainage provided on site, in particular during and after rain.

5.2.9 The monitoring of pesticides were summarised in **Table 5.2-3**.

Table 5.2-3 Pesticides Monitoring Results August 2007

Date	Monitoring Station	Parameters	Monitoring Result
3 rd Aug 07	M_BP, M_Coral, TTC, F_DB	Chlorpyrifos	Undetectable (0.01 µg/L)
3 rd Aug 07	M_BP, TTC, F_DA	Glyphosate	Undetectable (0.01 µg/L)
9 th Aug 07	F_Inland M, M_Marsh, TTC, M_BP	Chlorpyrifos	Undetectable (0.01 µg/L)
10 th Aug 07	M_BP, TTC	Fipronil	Undetectable (0.01 µg/L)
15 th Aug 07	F_Inland M, M_Marsh, TTC, M_BP	Chlorothalonil	Undetectable (0.01 µg/L)
18 th Aug 07	M_BP, TTC, F_DA	Chlorpyrifos	Undetectable (0.01 µg/L)
20 th Aug 07	M_BP, M_Coral, TTC, F_DB	Chlorpyrifos	Undetectable (0.01 µg/L)
23 rd Aug 07	M_BP, TTC, M_Coral, KS, F_DA, F_DC	Chlorpyrifos	Undetectable (0.01 µg/L)
28 th Aug 07	M_BP, M_Coral, TTC, F_DB	Chlorpyrifos	Undetectable (0.01 µg/L)
31 st Aug 07	M_BP, TTC	Chlorpyrifos	Undetectable (0.01 µg/L)

5.2.10 For the upstream monitoring location (F_UB), it is located downstream to the construction area near Hole 10 and the monitoring location cannot be relocated further upstream (temporary bridges located at Streams B1 and B2) as no water was observed and available for sampling. For Stream C, exceedances were recorded at both upstream and downstream monitoring locations. For the upstream monitoring location (F_UC), it is located downstream to the construction area near Hole 16 and the monitoring location cannot be relocated further upstream as no water was observed and available for sampling. Therefore, the F_UC is considered the most upstream location of Stream C. Same as Stream B, it is considered that F_UC is also the impact monitoring location and F_UA was used as the representative control monitoring station.

5.3 Ecology

5.3.1 Terrestrial and marine ecology monitoring photos are provided in **Annex E**.

Terrestrial Ecology

5.3.2 The Monitoring Survey for the reporting month was conducted on 14th and 20th September 2007. The project site was fully under construction works.

5.3.3 Although the surveyed streams have not been previously affected by developments or pollution sources, they are relatively small. During the EIA study, water depth was found less than 0.3m in most of the stream reaches even during wet season. Within dry season, these streams would have very small surface flow or even no surface flow for most of the length.

5.3.4 Stream A is located within the Project Area. Its main stream section (downstream to the confluence of two tributaries) would be protected by stream buffer zone (**Figure 3.3**). Stream A had been heavily silted with sediments from eroded hillsides all year round, particularly at the main stream section. The stream had low flow.

5.3.5 The permanent bridge across Stream A was finished and the temporary access bridge had been removed. In the present monitoring survey, it was found that some remedial works were conducted in the main stream course of Stream A (the section downstream to the confluence of tributaries A1 and A2) (see **Photo Plate 5.3-1**). The remedial works were to remove the rubbles which were washed down from the upper Tributary A2 during pipe culvert construction in June 2006. Although the riparian vegetation were not affected by the rubbles, and Stream A was of the lowest ecological value among the four natural streams (it was heavily silted with sediments from eroded hillsides all year round and only very limited aquatic fauna were recorded before),

- this section of stream channel was temporarily lost. Remedial works had thus been requested by the ET for clearing the rubbles, restoring the channel and improving the water quality, as the conditions of this stream is expected to improve after the construction of the golf course extension (in which the eroded hill slopes would be replaced by turf). As observed in the present monitoring, a large portion of the fallen rubbles were removed. And a proposal for restoring Stream A would be provided by the Contractor later.
- 5.3.6 Stream B is located within the Project Area. It had clear flow (with little sediment in the stream beds) of moderate volume during the wet season. This stream also has two main tributaries, B1 and B2. The full length of Stream B (two tributaries and the main stream) would all be protected by buffer zone (**Figure 3.3**). Stream B also contains a long estuarine section of muddy sandy substrate.
- 5.3.7 An area of the buffer zone of Tributary B2 was previously accidentally cleared. As the function of the buffer zone for the stream protection might be affected, replanting with native shrub species was implemented as remedial action (see **Figure 5.3.1**).
- 5.3.8 Sedimentation had been reported on the stream bed in June and July 2007, and had been attributed to the heavy rainfall and the recently constructed pipeline in the vicinity, as no additional encroachment was found in the buffer zone and the vegetation inside. The abundance of aquatic fauna, in particular Atyid shrimps, had also been found very low. But in August 2007 survey, there was a certain degree of recovery in Stream B as the majority of the previously sighted sediments were absent, and the flow was clear and some species such as Freshwater shrimp *Macrobrachium* sp. resumed, though Atyid shrimp were not recorded. In the present survey, the flow in Stream B was still clear and no sign of sedimentation was found (see **Figure 5.3.1**). Moreover, Atyid shrimps and freshwater snails were recorded again in Stream B. These were sign of recovery.
- 5.3.9 Stream C is located within the Project Area. This stream also has two main tributaries. It has had low but clear flow. In contrast to Stream B, Stream C drains to a sandy beach at Kau Chung Wan, and therefore lacks a clear estuarine zone. The full length of Stream C (two tributaries and the main stream) were protected by buffer zone (**Figure 3.3**). However the vegetation of a small area of the buffer zone was accidentally damaged (see **Figure 5.3.1**). Remedial works such as replanting should be implemented for this area. The permanent bridge across Stream C had been in place, with the piers outside the buffer zone demarcation. The temporary bridge had been removed.
- 5.3.10 In June and July 2007, sedimentation in Stream C had been found on the majority of the main stream course of Stream C, and no aquatic fauna had been recorded. Some improvements were reported in August 2007 survey as the majority of the previously sighted sediments were absent, and the flow was clear. In the present monitoring however, sedimentation was found again on the majority of the main stream course of Stream C (see **Figure 5.3.1**). The surfaces of aquatic plants were also covered by sediment. No aquatic fauna was found in Stream C in this monitoring.
- 5.3.11 Stream D is located outside the Project Area but within the Assessment Area and is the main stream draining the west side of the Assessment Area. It had clear water and moderate flow levels. Stream D is the only stream with deeper water depth among the four streams (water depth over 0.3 m in some of the stream reaches). As Stream D is outside the construction area, buffer zone would not be needed for this stream. In the present survey, the flow was found clear in Stream D, and Atyid shrimp *Caridina trifasciata* was still recorded.
- 5.3.12 Aquatic fauna communities were checked during the monitoring survey. The sedimentation was found on the stream bed in Stream C and no aquatic fauna was recorded, while the environments

and some aquatic fauna resumed in Stream B. Atyid shrimps were not recorded in Stream B again, and *Caridina trifasciata* was still found in Stream D. Measures should be taken to prevent any further sedimentation incidents in the future.

Marine Ecology

- 5.3.13 The present Marine Ecological Monitoring Survey was conducted on 15th, 16th, 22nd, and 23rd September 2007. The weather conditions were good on those date, the underwater visibility was moderate (approximately 1.5m). At Site C and the Control Site, the 20 colonies of natural corals selected during the Baseline Survey were recovered and checked for conditions, while at Site B2, 50 tagged corals (with 10 established in the Baseline Survey and 40 established in April 2006) were also checked. In previous monitoring surveys, one of the 20 tagged colonies at Control Site (i.e. X-05) and five of the 50 tagged corals at Site B2 (B-19, B-50, B-51, B-59 and B-60) were found lost, probably due to the strong wave actions during typhoon weather. The 89 transplanted corals were monitored for the fourth time after transplantation in this month, which was also the final monitoring for transplanted corals.
- 5.3.14 Site B2 was the location for the temporary barging point. Some rectangular concrete blocks were deployed along the seaward side of the intertidal zone to form a seawall, and the area landward to this wall was filled with boulders. This was used as the landing point of the temporary barging point. Road surface was formed near the abandoned pier and connected to the landing point. The conditions of the tagged corals during the present survey were compared with the conditions during the Baseline Survey (for B-11 to B-20) or in April 2006 (for B-21 to B-60) (**Annex E - Photo Plates 5.3-2 to 5.3-6**). In previous monitoring five tagged corals at this site (i.e. B-19, B-50-B-51, B-59 and B-60) had been found missing, and were considered removed by the wave actions during the adverse weather conditions such as typhoons. Further to these, one more tagged corals was found missing in the present monitoring (B-16)
- 5.3.15 Mortality had been found on some tagged corals in Site B in previous monitoring. In the present monitoring, most of the tagged corals were in conditions similar as recorded in previous monitoring, except increase of mortality was recorded on several colonies, including B-12 (increased from zero to 50%), B-17 (increased from 20% to 50%), B-54 (increased from zero to 50%) and B-55 (increased from 40% to 60%)(see **Table 5.3-1**). But these mortality records were still below the Action Level for the coral monitoring, i.e. “a 15% increase in the percentage of partial mortality of corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites”. The remaining tagged corals were still similar with the baseline conditions during the Baseline Survey in December 2005 or in April 2006. Minor sedimentation was sighted on some of the tagged corals, as well as on the seabed. Bleaching was not recorded on any tagged corals in Site B. Further measures to control the sedimentation from transferring fill materials on the barge should be taken.
- 5.3.16 Site C was on the south-eastern coast of Kau Sai Chau Island and had a high coral coverage among the sites investigated during the EIA Study. The sizes of coral colonies at Site C were also larger than those at other sites. Site C was away from the boundary of the new golf course and would not be subject to direct impacts during construction. The site and its vicinity still remained similar conditions as during the Baseline Survey. All 20 tagged corals in Site C were recovered. No mortality or sedimentation was found on other tagged corals (see **Table 5.3-2** and **Annex E - Photo Plates 5.3-7 to 5.3-8**). Bleaching in the surrounding untagged corals reported in previous monitoring was not found in the present monitoring.
- 5.3.17 The Control Site is the buoy of coral marker established by AFCD in Sharp Island. Similar with Site C, both the coral coverage percentage and the sizes of coral colonies were high at this site and would not be impacted by the Project. The site and its vicinity still remained similar conditions as during the Baseline Survey. Coral X-05 was lost in previous monitoring in June

2006. The remaining 19 tagged corals were recovered. The corals remained similar conditions as during the Baseline Survey (**Annex E - Photo Plates 5.3-9 to 5.3-10**). No mortality, sedimentation or bleaching was found on any of the tagged corals (see **Table 5.3-3**).

5.3.18 The 89 transplanted corals were checked for the fourth time (also the final one) after the transplantation survey. The site was the bedrock near Site D2, to the south of the existing ferry pier. This site is less exposed than other sites such as Site C as it is facing Sharp Island and the Sai Kung direction. Among the 89 transplanted corals, 86 colonies were recovered, but Corals No.68, 71, and 81 were found missing. Some transplanted colonies were found with a certain degree of mortality, but no sedimentation or bleaching was found (see **Table 5.3-4**). The corals remained similar with the baseline conditions during the transplantation survey (**Annex E - Photo Plates 5.3-11 to 5.3-16**).

5.3.19 **Photo Plates 5.3-2 to 5.3-16** showed the photos of each tagged corals and transplanted corals. The assigned numbers, species, mortality percentage, sedimentation coverage percentage and bleaching percentage of the baseline conditions of tagged corals and transplanted corals and their present conditions were presented in **Tables 5.3-1 to 5.3-4** below.

Table 5.3-1 Conditions of tagged corals at Site B2

Code of tagged corals	Species*	Baseline Survey (December 2005 or April 2006)			Month 21 (Sep. 2007)		
		Mortality (%)	Sedimentation (%)	Bleaching (%)	Mortality (%)	Sedimentation (%)	Bleaching (%)
Within the Temporary Barging Point Area							
B-11	<i>Turbinaria peltata</i>	0	0	0	50	0	0
B-12	<i>Plesiastrea versipora</i>	0	0	0	50	5	0
B-13	<i>Plesiastrea versipora</i>	0	0	0	30	10	0
B-14	<i>Goniastrea aspera</i>	0	0	0	0	0	0
B-15	<i>Lithophyllon undulatum</i>	0	0	0	0	10	0
B-16	<i>Favia speciosa</i>	0	0	0	Missing	Missing	Missing
B-17	<i>Favia speciosa</i>	0	0	0	50	0	0
B-18	<i>Turbinaria peltata</i>	0	0	0	20	0	0
B-19	<i>Favia speciosa</i>	0	0	0	Missing	Missing	Missing
B-20	<i>Favia speciosa</i>	0	0	0	0	0	0
To the North of the Temporary Barging Point Area							
B-21	<i>Favia speciosa</i>	0	0	0	0	0	0
B-22	<i>Cyphastrea serailia</i>	0	0	0	0	10	0
B-23	<i>Favia speciosa</i>	0	0	0	0	0	0
B-24	<i>Favia speciosa</i>	0	0	0	0	0	0
B-25	<i>Favites abdita</i>	0	0	0	0	0	0
B-26	<i>Cyphastrea serailia</i>	0	0	0	15	0	0
B-27	<i>Favia speciosa</i>	0	0	0	0	0	0
B-28	<i>Goniopora columna</i>	0	0	0	0	0	0
B-29	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
B-30	<i>Favia speciosa</i>	0	0	0	0	0	0
B-31	<i>Platygyra acuta</i>	5	0	0	0	0	0
B-32	<i>Favia speciosa</i>	3	0	0	0	0	0
B-33	<i>Turbinaria peltata</i>	0	0	0	0	0	0

Code of tagged corals	Species*	Baseline Survey (December 2005 or April 2006)			Month 21 (Sep. 2007)		
		Mortality (%)	Sedimentation (%)	Bleaching (%)	Mortality (%)	Sedimentation (%)	Bleaching (%)
B-34	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
B-35	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
B-36	<i>Platygyra acuta</i>	0	0	0	0	0	0
B-37	<i>Favia speciosa</i>	0	0	0	0	10	0
B-38	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
B-39	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
B-40	<i>Favia speciosa</i>	0	0	0	0	0	0
To the south of the Temporary Barging Point Area							
B-41	<i>Leptastrea pruinosa</i>	0	0	0	0	0	0
B-42	<i>Goniastrea aspera</i>	0	0	0	20	0	0
B-43	<i>Favia speciosa</i>	0	0	0	0	0	0
B-44	<i>Cyphastrea serailia</i>	0	0	0	0	20	0
B-45	<i>Platygyra acuta</i>	0	0	0	0	0	0
B-46	<i>Favia speciosa</i>	0	0	0	0	0	0
B-47	<i>Favites abdita</i>	0	0	0	0	0	0
B-48	<i>Cyphastrea serailia</i>	0	0	0	0	10	0
B-49	<i>Goniopora columna</i>	0	0	0	0	0	0
B-50	<i>Favia speciosa</i>	0	0	0	Missing	Missing	Missing
B-51	<i>Psammocora superficialis</i>	0	0	0	Missing	Missing	Missing
B-52	<i>Favia speciosa</i>	0	0	0	0	0	0
B-53	<i>Favia speciosa</i>	0	0	0	0	0	0
B-54	<i>Favia speciosa</i>	0	0	0	50	0	0
B-55	<i>Goniastrea aspera</i>	0	0	0	60	0	0
B-56	<i>Platygyra carnosus</i>	0	0	0	0	0	0
B-57	<i>Goniastrea aspera</i>	0	0	0	0	0	0
B-58	<i>Favia speciosa</i>	5	0	0	30	0	0
B-59	<i>Favia speciosa</i>	0	0	0	Missing	Missing	Missing
B-60	<i>Favia speciosa</i>	5	0	0	Missing	Missing	Missing

* Damaged corals were bold.

Table 5.3-2 Conditions of tagged corals at Site C

Code of tagged corals	Species	Baseline Survey (December 2005)			Month 21 (Sep. 2007)		
		Mortality (%)	Sedimentation (%)	Bleaching (%)	Mortality (%)	Sedimentation (%)	Bleaching (%)
C-01	<i>Platygyra carnosus</i>	0	0	0	0	0	0
C-02	<i>Platygyra carnosus</i>	0	0	0	0	0	0
C-03	<i>Favia speciosa</i>	0	0	0	0	0	0
C-04	<i>Favites abdita</i>	0	0	0	100	0	0

Code of tagged corals	Species	Baseline Survey (December 2005)			Month 21 (Sep. 2007)		
		Mortality (%)	Sedimentation (%)	Bleaching (%)	Mortality (%)	Sedimentation (%)	Bleaching (%)
C-05	<i>Turbinaria peltata</i>	0	0	0	0	0	0
C-06	<i>Favia speciosa</i>	0	0	0	0	0	0
C-07	<i>Platygyra acuta</i>	0	0	0	0	0	0
C-08	<i>Platygyra acuta</i>	0	0	0	0	0	0
C-09	<i>Favia speciosa</i>	0	0	0	0	0	0
C-10*	<i>Platygyra acuta</i>	0	0	0	0	0	0
C-11	<i>Favia speciosa</i>	0	0	0	0	0	0
C-12	<i>Platygyra acuta</i>	0	0	0	0	0	0
C-13	<i>Platygyra carnosus</i>	0	0	0	0	0	0
C-14	<i>Favia speciosa</i>	0	0	0	0	0	0
C-15	<i>Goniopora columna</i>	0	0	0	0	0	0
C-16	<i>Platygyra carnosus</i>	0	0	0	0	0	0
C-17	<i>Goniopora columna</i>	0	0	0	0	0	0
C-18	<i>Platygyra carnosus</i>	0	0	0	0	0	0
C-19	<i>Favites pentagona</i>	0	0	0	0	0	0
C-20	<i>Favia speciosa</i>	0	0	0	0	0	0

*C-10 had sign of anchor damages.

Table 5.3-3 Conditions of tagged corals at Control Site

Code of tagged corals	Species	Baseline Survey (December 2005)			Month 21 (Sep. 2007)		
		Mortality (%)	Sedimentation (%)	Bleaching (%)	Mortality (%)	Sedimentation (%)	Bleaching (%)
X-01	<i>Platygyra carnosus</i>	0	0	0	0	0	0
X-02	<i>Platygyra carnosus</i>	0	0	0	0	0	0
X-03	<i>Platygyra carnosus</i>	0	0	0	0	0	0
X-04	<i>Pavona decussata</i>	0	0	0	0	0	0
X-05	<i>Hydnophora exesa</i>	0	0	0	Missing	Missing	Missing
X-06	<i>Platygyra carnosus</i>	0	0	0	0	0	0
X-07	<i>Platygyra carnosus</i>	0	0	0	0	0	0
X-08	<i>Favites abdita</i>	0	0	0	0	0	0
X-09	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
X-10	<i>Cyphastrea serailia</i>	0	0	0	0	0	0
X-11	<i>Platygyra carnosus</i>	0	0	0	0	0	0
X-12	<i>Platygyra acuta</i>	0	0	0	0	0	0
X-13	<i>Platygyra acuta</i>	0	0	0	0	0	0
X-14	<i>Platygyra acuta</i>	0	0	0	0	0	0
X-15	<i>Platygyra acuta</i>	0	0	0	0	0	0
X-16	<i>Platygyra acuta</i>	0	0	0	0	0	0

Code of tagged corals	Species	Baseline Survey (December 2005)			Month 21 (Sep. 2007)		
		Mortality (%)	Sedimentation (%)	Bleaching (%)	Mortality (%)	Sedimentation (%)	Bleaching (%)
X-17	<i>Favia speciosa</i>	0	0	0	0	0	0
X-18	<i>Platygyra acuta</i>	0	0	0	0	0	0
X-19	<i>Goniastrea aspera</i>	0	0	0	0	0	0
X-20	<i>Cyphastrea serialia</i>	0	0	0	0	0	0

Table 5.3-4 Conditions of transplanted corals

Coral #	Species	Baseline Condition	Baseline			4 th monitoring		
			Mortality (%)	Sediment (%)	Bleaching (%)	Mortality (%)	Sediment (%)	Bleaching (%)
1	<i>Montipora peltiformis</i>	Good	0	0	0	0	0	0
2	<i>Porites lobata</i>	Good	0	0	0	0	0	0
3	<i>Favites abdita</i>	Good	0	0	0	0	0	0
4	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
5	<i>Porites lobata</i>	Good	0	0	0	0	0	0
6	<i>Porites lobata</i>	Good	0	0	0	0	0	0
7	<i>Porites lobata</i>	Good	0	0	0	0	0	0
8	<i>Porites lobata</i>	Fairly Good	0	0	0	0	0	0
9	<i>Favites abdita</i>	Good	0	0	0	0	0	0
10	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
11	<i>Favites pentagona</i>	Good	0	0	0	0	0	0
12	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
13	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
14	<i>Favites abdita</i>	Good	0	0	0	0	0	0
15	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
16	<i>Goniastrea aspera</i>	Good	0	0	0	0	0	0
17	<i>Favites abdita</i>	Fairly Good	0	0	0	0	0	0
18	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
19	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
20	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
21	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
22	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
23	<i>Montipora peltiformis</i>	Fairly Good	0	0	0	0	0	0
24	<i>Psammocora superficialis</i>	Good	0	0	0	0	0	0

Coral #	Species	Baseline Condition	Baseline			4 th monitoring		
			Mortality (%)	Sediment (%)	Bleaching (%)	Mortality (%)	Sediment (%)	Bleaching (%)
25	<i>Psammocora superficialis</i>	Good	0	0	0	50	0	0
26	<i>Porites lobata</i>	Fairly Good	0	0	0	0	0	0
27	<i>Favia speciosa</i>	Good	0	0	0	0	0	0
28	<i>Porites lobata</i>	Good	0	0	0	0	0	0
29	<i>Psammocora superficialis</i>	Fairly Good	0	0	0	0	0	0
30	<i>Favites abdita</i>	Good	0	0	0	80	0	0
31	<i>Favites pentagona</i>	Good	0	0	0	0	0	0
32	<i>Favites pentagona</i>	Good	0	0	0	0	0	0
33	<i>Montipora peltiformis</i>	Fairly Good	0	0	0	0	0	0
34	<i>Goniopora stutchburyi</i>	Fairly Good	0	0	0	0	0	0
35	<i>Porites lobata</i>	Good	0	0	0	0	0	0
36	<i>Porites lobata</i>	Good	0	0	0	0	0	0
37	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
38	<i>Favites abdita</i>	Good	0	0	0	0	0	0
39	<i>Psammocora superficialis</i>	Good	0	0	0	0	0	0
40	<i>Psammocora superficialis</i>	Fairly Good	0	0	0	0	0	0
41	<i>Favites pentagona</i>	Good	0	0	0	0	0	0
42	<i>Favia speciosa</i>	Good	0	0	0	0	0	0
43	<i>Cyphastrea serialia</i>	Fairly Good	0	0	0	0	0	0
44	<i>Porites lobata</i>	Fairly Good	0	0	0	0	0	0
45	<i>Porites lobata</i>	Good	0	0	0	0	0	0
46	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
47	<i>Goniastrea aspera</i>	Good	0	0	0	0	0	0
48	<i>Porites lobata</i>	Good	0	0	0	0	0	0
49	<i>Porites lobata</i>	Fairly Good	0	0	0	0	0	0
50	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
51	<i>Favia speciosa</i>	Good	0	0	0	0	0	0
52	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
53	<i>Porites lobata</i>	Good	0	0	0	0	0	0
54	<i>Porites lobata</i>	Good	0	0	0	0	0	0
55	<i>Porites lobata</i>	Good	0	0	0	0	0	0
56	<i>Favia speciosa</i>	Fairly Good	0	0	0	0	0	0
57	<i>Goniastrea aspera</i>	Good	0	0	0	0	0	0
58	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
59	<i>Pavona descussata</i>	Good	0	0	0	0	0	0
60	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0

Coral #	Species	Baseline Condition	Baseline			4 th monitoring		
			Mortality (%)	Sediment (%)	Bleaching (%)	Mortality (%)	Sediment (%)	Bleaching (%)
61	<i>Favites abdita</i>	Good	0	0	0	0	0	0
62	<i>Pavona descussata</i>	Good	0	0	0	0	0	0
63	<i>Lithophyllon undulatum</i>	Good	0	0	0	0	0	0
64	<i>Porites lobata</i>	Good	0	0	0	0	0	0
65	<i>Psammocora superficialis</i>	Good	0	0	0	0	0	0
66	<i>Porites lobata</i>	Good	0	0	0	0	0	0
67	<i>Lithophyllon undulatum</i>	Good	0	0	0	0	0	0
68	<i>Porites lobata</i>	Fairly Good	0	0	0	Missing	Missing	Missing
69	<i>Favia speciosa</i>	Good	0	0	0	0	0	0
70	<i>Goniastrea aspera</i>	Good	0	0	0	0	0	0
71	<i>Porites lobata</i>	Good	0	0	0	Missing	Missing	Missing
72	<i>Porites lobata</i>	Fairly Good	0	0	0	0	0	0
73	<i>Cyphastrea serialia</i>	Fairly Good	0	0	0	0	0	0
74	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
75	<i>Porites lobata</i>	Good	0	0	0	0	0	0
76	<i>Goniastrea aspera</i>	Good	0	0	0	0	0	0
77	<i>Favites abdita</i>	Good	0	0	0	0	0	0
78	<i>Favites abdita</i>	Good	0	0	0	0	0	0
79	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
80	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
81	<i>Porites lobata</i>	Good	0	0	0	Missing	Missing	Missing
82	<i>Goniastrea aspera</i>	Good	0	0	0	30	0	0
83	<i>Favia speciosa</i>	Good	0	0	0	0	0	0
84	<i>Favites pentagona</i>	Good	0	0	0	0	0	0
85	<i>Goniopora stutchburyi</i>	Good	0	0	0	0	0	0
86	<i>Favites abdita</i>	Good	0	0	0	0	0	0
87	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
88	<i>Cyphastrea serialia</i>	Good	0	0	0	0	0	0
89	<i>Favia speciosa</i>	Good	0	0	0	0	0	0

5.4 Archaeology (Watching Brief)

Final Archaeology Watching Brief Report

5.4.1 The Final Archaeology Watching Brief Report was submitted to AMO in June 2007. No archaeological material was identified.

6. Environmental Site Auditing

6.1.1 The weekly site inspections were conducted by the ET with Contractor's representative and/or Jockey Club's representative on 31st August, 5th, 11th and 18th September 2007, and the monthly joined site inspection with IEC and the Contractor's representative undertaken on 18th September 2007. The following observations and recommendations were made.

Dust Mitigation Measures

- 6.1.2 Dust generation from the haul road, during earth moving operation and excavation were observed at sunny and windy weather, insufficient dust mitigation measures was provided on site.
- 6.1.3 Temporary huge soil stockpile was mainly located at Hole 1 and vulnerable to silty runoff and dust generation. Formerly hydroseeded area at the soil stockpile was dead which could not serve a proper mitigation measures for dust suppression. For sand/aggregates stockpiles which were mainly located at Hole 9. The Contractor was reminded to provide mitigation measures to prevent dust generation due to wind erosion.
- 6.1.4 The Contractor was reminded to minimize the dust generated by the site vehicles moving along the haul road by paving the heavy traffic haul road, watering etc. The Contractor was repeatedly reminded to provide sufficient dust suppression measure at all other excavation / earth moving areas.
- 6.1.5 As permanent cart path, turfing and hydroseeding areas (permanent areas and eroded slope) will be gradually completed, therefore, dust generation will gradually decrease from the construction site is expected.
- 6.1.6 Concrete batching plant was being dismantled during this reporting month. No major dust generation was observed from the concrete batching plant during operation and dismantling.
- 6.1.7 The Contractor was reminded to install the hoarding near to the main exit/entrance near S7 according to the Air Pollution Control Ordinance and its subsidiary regulations. It was outstanding for at least few months.

Water Quality

Temporary Drainage Management Plan

- 6.1.8 Although the Contractor had tried to rectify the collapsed silt fence after heavy rains at vulnerable low lying areas, water quality monitoring data revealed that the temporary drainage installed on site was considered insufficient and ineffective, in particular, to streams. No additional or provision of effective measures was observed to prevent the silty runoff at those vulnerable areas. However, sand capping and turfing can significantly reduce the potential silty runoff during rain. As most of the turf was planted at Northern section of East Course, silty runoff at those areas would be reduced.
- 6.1.9 Similar to previous month, more hydroseeding areas for final golf course layout and scar areas were established gradually in the past few months. It can effectively reduce the erosion. However, many of the areas had to be re-planting due to the poor maintenance and low coverage of the grass.

- 6.1.10 The Contractor was urged to revise the Temporary Drainage Management Plan (TDMP) layout plans and present the actual (temporary and permanent drainage system) installation/construction completion date of each golf hole. Interim reports regarding the TDMP progress should be submitted and revised from time to time. If the permanent drainage system is not available at some particular areas, temporary drainage system should be sufficiently installed to prevent runoff entering to nearby water quality sensitive receivers directly. There is no further update submission of TDMP for RE approval.
- 6.1.11 The Contractor was reminded to provide sufficient desilting / treatment facilities on site in order to comply the WPCO for all discharged water from the construction site. According to the site observation, only one of the desilting facility was located and without any pipeline connection at Hole 9 during the reporting month. It was considered not ready to operate.
- 6.1.12 No dredging work for the permanent intake and outfall pipelines was carried out during the reporting month.
- 6.1.13 Construction of permanent bridges was completed before the wet season 2007. Remaining furnishing work was in progress during the reporting month.
- 6.1.14 The Contractor was reminded to maintain the silt curtain and desilt the settled solids within the silt curtain in a routine basis and ensure the effectiveness of its intended use. Silt curtain located at the downstream of Stream A was torn. The Contractor was reminded to maintain the integrity of the silt curtain at all times.

Turfing

- 6.1.15 Fertilizer applications were recorded at Holes 3-8, 11-16 on regular basis according to the turf establishment requirement and approved turf grass management plan. Chemical applications were applied at the Holes 3-8, 11, 13-16 and 18 during the reporting month. Water quality monitoring on fertilizer and pesticides covered the whole part of East Course during this reporting month.

Ecology

- 6.1.16 Buffer zone at Streams A, B1, B2 and C had been fully established. The whole buffer zone aims to protect the streams and avoid any works/equipment intrusion into the buffer zone.
- 6.1.17 Stream A was found to be filled up by rubbles to the level of the weirs at its downstream end since mid-June 2006. The second incident was occurred on 21st November 2006. Remedial works were implemented to clear the rubbles and restore the channel manually. Unfortunately, the third incident was occurred on 3rd July 2007 after heavy rains. The Contractor completely cleared the rubbles and the reinstatement work was proposed during last reporting month.
- 6.1.18 No illegal berthing was observed during the site audit. Floating pontoon was berthed at EP location at the temporary barging point. The barges were mainly delivering sand, aggregates and turf during the reporting month.

Streams B & C Buffer Zone

- 6.1.19 Regarding to the vegetation clearance of Streams B & C buffer zone due to the permanent drainage construction work, the area was planting with shrubs. The Contractor was reminded to keep the reinstated area in good and healthy condition for the newly plants.

Waste / Chemical Management

- 6.1.20 According to the site observation, construction wastes stockpile was accumulated at Hole 2 and not disposed off-site during the reporting month. The Contractor was reminded to submit trip-ticket records and construction waste disposal records during the reporting month.
- 6.1.21 Insufficient mobile/chemical toilets were provided at the construction site. The Contractor was repeatedly reminded to provide sufficient toilets in particular at works site distant from the Contractor's office.
- 6.1.22 There was no direct discharge from the temporary sewage treatment plant (temporarily stored and disposed off-site by the Contractor) during the reporting month. However, RE and Contractor were confirmed leakage of sewage from the pipelines on 16 July 2007 which leading to indirect discharge to the fresh water inland marsh. CHEC rectified the situation and provided a 15 m³ storage tank for temporary storage of sewage effluent. The Contractor was reminded to repair the sewage treatment plant to ensure the sewage effluent quality comply with the discharge licence at all times. There was no submission provided by the Contractor regarding to the water quality during this reporting month.

Landscape and Visual

- 6.1.23 The landscape and visual monitoring and site audits were carried out on 7th and 21st September 2007. During the site audits, site formation, shaping, planting and building construction were carried out. Shrub seedlings were planted on slopes of Hole 2, 4, 5, 6, 10 and 11. Some of the newly planted shrubs are lack of watering. The Contractor shall irrigate all the plants and hydroseeded area more frequently.
- 6.1.24 Damaged trees next to the administration building were still unprotected after being damaged by the adjacent construction activities.
- 6.1.25 All transplanted trees were in fair condition except for T848. Mal-pruning of transplanted trees has not been rectified. Construction material was stockpiled within tree protection zones. A statement on the cause of death of tree T925 recorded in the last report is still outstanding.

Status of Environmental Licensing and Permitting

- 6.1.26 Permits / licences submission and approval status are summarised in Table 6.1.

Table 6.1 Summary of Environmental Licensing and Permit Status

Permit/licence/notification form title	Submission date	Status	Registration No./Remarks
Application for a construction noise permit for the use of powered mechanical equipment for the purpose of carrying out construction work other than percussive piling and/or the carrying out of prescribed construction work.	21 st Jan 2006	Approved on 16 th February 2006	GW-RE0012-06 (valid until 3 rd July 2006)
Application for a construction noise permit for the use of powered mechanical equipment for the purpose of carrying out construction work other than percussive piling and/or the carrying out of prescribed construction work.	6 th Apr 2006	Approved on 9 th Jun 06 (supersede the GW-RE0012-06)	GW-RE0157-06 (valid until 28 th Nov 2006)
Application for a construction noise permit for the use of powered mechanical equipment for the purpose of carrying out construction work other than percussive piling and/or the carrying out of prescribed construction work.	Nov 2006	Approved on 22 nd Nov 06 (supersede the GW-RE0157-06)	GW-RE0384-06 (valid until 26 th May 2007).
Application for a construction noise permit for the use of powered mechanical equipment for the purpose of carrying out construction work other than percussive piling and/or the carrying out of prescribed construction work.	4 th May 2007	Approved on 18 th May 07 (supersede the GW-RE0384-06)	GW-RE0141-07 (valid until 25 th Nov 2007).
Notification of the air pollution control (construction dust) regulation	21 st Jan 2006	Acknowledge receipt from EPD on 27 th February 2006	Ref. no.: 001006902
Registration as a chemical waste producer	10 th Jan 2006	Register on 7 th February 2006	WPN-5213-813-C1186-04
Application for a permit to dump material at sea under the Dumping at Sea Ordinance	10 th Jan 2006	Deferred by CHEC on 17 th March 2006 (CHEC/KSC3.9.1/0459)	No dredging work will be carried out between May to December 2006.
<i>Application of exemption account for the construction waste charging scheme***</i>	<i>12th Jan 2006</i>	<i>Approved on 16th January 2006</i>	<i>A/C no. 5005322 (valid until 2nd August 2007)</i>
Application for a licence for production pursuant to Section 14 of Air pollution Control Ordinance	2 nd Mar 2006	The total silo capacity for the cement works was 45 tonnes which is lower than 50 tonnes. It is not a specified process, application is not required.	EPD letter refer. no.: EP640/EA/SK/015
Application for a licence under Water Pollution Ordinance – Construction Site	18 th Mar 2006	Approved on 12 th Sept 2006 (CHEC/KSC3/9.1/0414)	EPD letter refer. No: EP640/W4/J1003

*** The exemption account for the construction waste charging scheme was expired on 2nd August 2007. The Contractor reported the exemption account for the construction waste charging scheme was renewed during this reporting month, however, no information was submitted to the ET for checking.

7. Environmental Non-Conformance

7.1 Summary of Environmental Non-Compliance

Air Quality

- 7.1.1 No exceedance of 24-hour TSP was recorded at GCA B1 during the reporting month.

Marine Water Quality

- 7.1.2 Twelve exceedances were recorded at M_RO1, KLW, M_Marsh, TTC, M_BP and KS. Exceedances were mainly due to the natural variation of marine water. Therefore, they were considered as non-project related and non-turfing related.

Freshwater Quality

- 7.1.3 Twelve exceedances of turbidity and eleven exceedances of suspended solids were recorded at the Streams A, B, C and the Fresh Water Inland Marsh. Exceedances were mainly due to silty runoff and insufficient temporary drainage provided on-site and considered project related.

- 7.1.4 Five exceedances of ammonia nitrogen, eleven exceedances of nitrate nitrogen, fourteen exceedances of total inorganic nitrogen and twelve exceedances of chlorophyll a were recorded at the Streams A, B & C and the Fresh Water Inland Marsh. Exceedances were considered low and various without fluctuated. Therefore, nutrient exceedances were considered non-project related.

Terrestrial Ecology

- 7.1.5 Although the buffer zones for Stream A, B, and C were basically intact, sedimentation was however observed in Stream B and C, and the abundance of aquatic fauna, in particular caridian shrimps, was found very low during the reporting month.

Marine Ecology

- 7.1.6 In the present survey, minor sedimentation on some of the tagged corals at Site B2 were observed, and one more colony (i.e. B-16) was found missing.

7.2 Summary of Environmental Complaint

- 7.2.1 No environmental complaint was received in this reporting month.

7.3 Summary of Environmental Summons

- 7.3.1 No summon was received in this reporting month.

8. Future Key Issues

8.1 Key Issues for coming month

8.1.1 Major works to be taken for the coming monitoring period are summarized as follows.

- Operation of temporary barging point
- Operation of sewage treatment plant
- Drainage and irrigation systems installation at Golf Holes
- Sand capping and turf establishment at Golf Holes
- Implementation of temporary drainage master plan
- Operation of desalination plant if required

8.2 Monitoring Schedule for the coming month

8.2.1 The tentative schedule of air, water, ecology and landscape & visual monitoring for the next three months is presented in **Annex F**. The environmental monitoring will be conducted at the same monitoring locations in this reporting month. The monitoring programme has been reviewed and was considered as adequate to cater the nature of works to be undertaken.

8.3 Construction programme for the next three month

8.3.1 The construction programme for the next three months is presented in **Annex G**.

9. Recommendations and Conclusions

- 9.1.1 The Environmental Monitoring and Audit (EM&A) Report presents the EM&A works undertaken during the period from 25th August to 24th September 2007 in accordance with EM&A Manual and the requirement under EP-224-2005/A.
- 9.1.2 The Contractor was repeatedly reminded to improve and provide sufficient temporary drainage system on-site to prevent silty runoff to marine and stream courses. The Contractor was reminded to provide sufficient dust suppression mitigation measures especially during earth movement (loading and unloading), at haul road (vehicle movement) and large soils stockpiles. In addition, the Contractor was reminded to provide sufficient temporary drainage at the turfing areas.
- 9.1.3 Although the buffer zones for Stream A, B, and C were basically intact, sedimentation was however observed in Stream B and C, and the abundance of aquatic fauna, in particular caridian shrimps, was found very low. The Contractor was urged to provide effective measures to prevent silty runoff to streams.
- 9.1.4 Same as the last reporting month, no additional rectification work except maintenance of the existing silt fence was done by the Contractor. Regarding the retained trees, the Contractor shall take the following measures:
- Carry out surgery to damaged trees;
 - Report the cause of death of tree T925;
 - Re-fix the label of retained tree for easy identification;
 - Maintain the tree protection zone required and remove all construction material / debris from the tree protection zone;
 - More frequent watering for transplanted trees, planted vegetation and hydroseeded grass; and
 - Rectify the mal-pruning practice of the transplanted trees.
- 9.1.5 No environmental complaint / summon was received during the reporting month.
- 9.1.6 The ET will keep track of the EM&A programme with respect to compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Annex A

Tentative Construction Programme

Activity ID	Activity Description	Target 1 Orig Dur	Target 1 Early Start	Target 1 Early Finish	2005												2006												2007												2008
					Q D J F M A M J J A S O N D												J F M A M J J A S O N D												J F M A M J J A S O N D												J
SUMMARY PROGRAMME																																									
SU00100	Possession of Site	0	03/01/06A																																						
SU00120	Completion of Section 2	0		12/06/08																																					
SU0014B	Completion of Section 4 EOT 25days (3 Apr 07)	0		02/08/07																																					
SU0015B	Completion of Section 9 EOT 85days (25 Oct 07)	0		21/12/07																																					
SU00160	S1: Low level intake pumping station	141*	25/10/06A	20/04/07A																																					
SU00170	S1: Gravity drain & rising main	233*	10/06/06A	24/03/07A																																					
SU00190	S2: Desalination plant	278*	18/02/06A	24/01/07A																																					
SU00200	S2: Transformer/switch room	153*	05/06/06A	04/12/06A																																					
SU00210	S2: Temp Seawater pumping station	85*	31/10/06A	09/02/07A																																					
SU00220	S2: Temp Seawater intake & discharge pipe	26*	31/10/06A	29/11/06A																																					
SU00230	S2: Retaining wall No.1	117*	27/05/06A	14/10/06A																																					
SU00240	S2: Lake No.1 and pump house No.1	174*	16/10/06A	21/05/07A																																					
SU00250	S2: Roundabout and access road	28*	08/09/06A	12/10/06A																																					
SU00260	S3: Existing maintenace building	301*	07/03/06A	16/03/07A																																					
SU00270	S4: Existing admin. building area 1	404*	21/03/06A	02/08/07																																					
SU00280	S4: Existing admin. building area 2	220*	08/10/06A	07/07/07A																																					
SU00290	S4: Existing admin. building area 3	319*	21/03/06A	21/04/07A																																					
SU00300	S4: Existing admin. building area 4	400*	21/03/06A	28/07/07																																					
SU00310	S4: Existing admin. building area 5	219*	07/03/06A	29/11/06A																																					
SU00330	S9: Earth/slope construction works	448*	10/03/06A	12/09/07																																					
SU00350	S9: Drainage & Irrigation	348*	16/08/06A	17/10/07																																					
SU00360	S9: Sand Capping (GH3, 5, 8, 18stg1)	225*	05/01/07A	09/10/07																																					
SU00370	S9: Sand Capping (GH4, 6, 7)	90*	22/01/07A	16/05/07A																																					
SU00380	S9: Sand Capping (GH1, 2 & 9-17)	178*	10/05/07A	08/12/07																																					
SU00390	S9: Grassing (GH3, 5, 8, 18)	133*	12/02/07A	28/07/07																																					
SU00400	S9: Grassing (GH4, 6, 7)	50*	19/04/07A	16/06/07A																																					
SU00410	S9: Grassing (GH1, 2 & 9-17)	151*	25/06/07A	21/12/07																																					

2005												2006												2007												2008
Q D J F M A M J J A S O N D												J F M A M J J A S O N D												J F M A M J J A S O N D												J

Start Date	28/12/05	Target1 Summary Bar
Finish Date	12/06/08	Progress Bar
Data Date	23/08/07	
Run Date	23/08/07 17:21	

7D36 China Harbour Engineering Co. Sheet 1 of 1
Summary of Date 1 Baseline Programme
 23/08/07

Date	Revision	Checked	Approved
28/12/05	4th Final for Submission	Tim	
01/03/06	Ver 5th (KST5)	Tim	

Annex B

Monitoring Programme for the reporting month

August 2007						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
						25 AQ
26	27 WQ	28	29	30	31 AQ	

September 2007						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
						1
2	3 WQ	4	5	6 AQ	7	8
9	10 WQ	11	12 AQ	13	14 TE	15 ME
16 ME	17 WQ	18 AQ	19	20 TE	21	22 ME
23 ME	24 AQ					

Remarks: AQ = TSP, WQ = Freshwater and Marine water quality, TE = Terrestrial Ecology, ME = Marine Ecology;
 LV = Landscape & Visual

Annex C

Event Action Plan

Event / Action Plan for Air Quality

EVENT	ACTION			
	ET	IC(E)	Engineer	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	1. Identify source, investigate the causes of complaint and propose remedial measures; 2. Inform IC(E) and Engineer; 3. Repeat measurement to confirm finding; 4. Increase to daily monitoring.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method.	1. Notify Contractor.	1. Rectify any unacceptable practice; 2. Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	1. Identify source; 2. Inform IC(E) and Engineer; 3. Advise Engineer on effectiveness of proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase to daily monitoring; 6. Discuss with IC(E) and Contractor remedial actions required; 7. If exceedance continues, arrange meeting with IC(E) and Engineer; 8. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor possible remedial measures; 4. Advise ET on the effectiveness of proposed remedial measures; 5. Supervise implementation of remedial measures.	1. Confirm in writing receipt of notification of exceedance; 2. Notify Contractor; 3. Supervise proper implementation of remedial measures.	1. Submit proposals for remedial measures to Engineer within three working days of notification; 2. Implement agreed proposals; 3. Amend proposal if appropriate.
LIMIT LEVEL				
1. Exceedance for one sample	1. Identify source, investigate causes of exceedance and propose remedial measures; 2. Inform IC(E), Engineer, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase to daily monitoring; 5. Assess effectiveness of Contractor's	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor possible remedial measures; 4. Advise Engineer on effectiveness of proposed remedial measures; 5. Supervise implementation of remedial measures.	1. Confirm in writing receipt of notification of exceedance; 2. Notify Contractor; 3. Supervise proper implementation of remedial measures.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IC(E) within three working days of notification; 3. Implement the agreed proposals; 4. Amend proposals if appropriate.

EVENT	ACTION			
	ET	IC(E)	Engineer	CONTRACTOR
	remedial actions and keep IC(E), EPD and Engineer informed of results.			
2 Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Notify IC(E), Engineer, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase to daily monitoring; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation measures to be implemented; 6. Arrange meeting with IC(E) and Engineer to discuss remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and Engineer informed of results; 8. If exceedance stops, cease additional monitoring. 	<p>Discuss amongst Engineer, ET, and Contractor the potential remedial actions;</p> <p>Review Contractor's remedial actions whenever necessary to assure their effectiveness, and advise Engineer accordingly;</p> <p>Supervise implementation of remedial measures.</p>	<p>Confirm receipt of notification of exceedance in writing;</p> <p>Notify Contractor;</p> <p>In consultation with the IC(E), agree with the Contractor the remedial measures to be implemented;</p> <p>Supervise proper implementation of remedial measures;</p> <p>If exceedance continues, consider what portion of the works is responsible and instruct the Contractor to stop that portion of work until exceedance has abated.</p>	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IC(E) within three working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as instructed by Engineer until the exceedance is abated.

Event and Action Plan for Water Quality

Event	ET Leader	IC(E)	Engineer	Contractor
ACTION LEVEL				
Action level being exceeded by one sampling day	Repeat <i>in situ</i> measurement to confirm findings; Identify reasons for non-compliance and source(s) of impact; Inform IC(E) and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IC(E) and Contractor; Repeat measurement on next day of exceedance.	Discuss mitigation measures with ET and Contractor ; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IC(E); Make agreement on mitigation measures to be implemented. Assess effectiveness of the implemented mitigation measures.	Inform the Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes in working methods; Discuss with ET and IC(E) and propose mitigation measures to IC(E) and Engineer; Implement agreed mitigation measures.
Action level being exceeded by more than two consecutive sampling days	Repeat <i>in situ</i> measurement to confirm findings; Identify reasons for non-compliance and source(s) of impact; Inform IC(E) and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IC(E) and Contractor; Ensure mitigation measures are implemented; Prepare to increase to daily monitoring; Repeat measurement on next day of exceedance.	Discuss mitigation measures with ET and Contractor ; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss the proposed mitigation measures with IC(E); Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	Inform Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes in working methods; Discuss with ET and IC(E) and propose mitigation measures to IC(E) and Engineer within three working days; Implement agreed mitigation measures.
LIMIT LEVEL				
Limit level being exceeded by one sampling day	Repeat <i>in situ</i> measurement to confirm findings; Identify reasons for non-compliance and source(s) of impact; Inform IC(E) Contractor and EPD; Check monitoring data, all plant, equipment	Discuss mitigation measures with ET and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented	Discuss proposed mitigation measures with IC(E), ET and Contractor; Request Contractor to critically review the working methods; Make agreement on mitigation measures to be implemented;	Inform Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes in working methods;

Event	ET Leader	IC(E)	Engineer	Contractor
	and Contractor's working methods; Discuss mitigation measures with IC(E), Engineer and Contractor; Ensure mitigation measures are implemented; Increase to daily monitoring until no exceedance of Limit level.	mitigation measures.	Assess effectiveness of implemented mitigation measures.	Discuss with ET, IC(E) and Engineer and propose mitigation measures to IC(E) and Engineer within three working days; Implement agreed mitigation measures.
Limit level being exceeded by more than two consecutive sampling days	Repeat <i>in situ</i> measurement to confirm findings; Identify reasons for non-compliance and source(s) of impact; Inform IC(E), Contractor and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IC(E), Engineer and Contractor; Ensure mitigation measures are implemented; Increase to daily monitoring until no exceedance of Limit level for two consecutive days.	Discuss mitigation measures with ET and Contractor; Review proposals on mitigation measures submitted by Contractor and advise Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IC(E), ET and Contractor; Request Contractor to critically review working methods; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures; Consider and if necessary instruct Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level.	Inform Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET, IC(E) and Engineer and propose mitigation measures to IC(E) and Engineer within three working days; Implement agreed mitigation measures; As directed by the Engineer, slow down or stop all or part of the construction activities until no exceedance of Limit level.

Action and Limit level and Event Action Plan for natural corals monitoring

Parameters	Action Level	Limit Level
Sedimentation	a 15% increase in the percentage of sedimentation on the hard corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites	a 25% increase in the percentage of sedimentation on the hard corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites
Bleaching	a 15% increase in the percentage of bleaching of hard corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites	a 25% increase in the percentage of bleaching of hard corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites
Mortality	a 15% increase in the percentage of partial mortality of corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites	a 25% increase in the percentage of partial mortality of corals occurs at more than 20% of the tagged coral colonies at one or more monitoring sites

Action	Action Level	Limit Level
Construction phase	If the Action Level is exceeded the ET Leader should inform all parties (Contractor, Project Proponent, EPD, AFCD and IEC). The data from the water quality monitoring should also be reviewed. If the water quality monitoring shows no attributable effects of the installation works, then the Action Level is not triggered. If the water quality data indicate exceedances (for SS and/or turbidity) the ET Leader should discuss with the Contractor the most appropriate method of reducing suspended solids during dredging (e.g. reduce the rate of dredging), and/or control sedimentation during earth works (e.g. check the intactness and effectiveness of the temporary drainage system and stream buffer zone). This mitigated method should then be enacted on the next working day.	If the Limit Level is exceeded the ET Leader should inform all parties (Contractor, Project Proponent, EPD, AFCD and IEC) immediately. Should the Limit Level be exceeded, the contractor should stop dredging and/or earth works immediately and work out the solution according to the requirements of EPD and AFCD. The ET Leader should inform the Contractor to suspend dredging and/or earth works until an effective solution is identified. Once the solution has been identified and agreed with all parties dredging and/or earth works may commence
Operation phase	If the Action Level is exceeded the ET Leader should inform Golf Course Operator, EPD, and AFCD. The data from the water quality monitoring should also be reviewed. If the water quality monitoring shows no attributable effects of the installation works, then the Action Level is not triggered. If the water quality data indicate exceedances (salinity and/or pesticides) the ET Leader should discuss with the Golf Course Operator the most appropriate method of reducing salinity (e.g. reduce the daily operation time of the desalination plant), and/or control chemicals from runoff (e.g. reduce the frequency and quantity of chemical applied, check the intactness and effectiveness of the closed drainage system and stream buffer zone). This mitigated method should then be enacted on the next working day.	If the Limit Level is exceeded the ET Leader should inform all parties Golf Course Operator, EPD, and AFCD immediately. Should the Limit Level be exceeded, the Golf Course Operator should stop the operation of the desalination plant and/or the application of chemicals immediately and work out the solution according to the requirements of EPD and AFCD. The operation of the desalination plant and/or the application of chemicals would be suspended until an effective solution is identified.

Categories of Archaeological Finds and Recommended Action

Categories of Archaeological Material	Retrieval Procedure
Human burial <ul style="list-style-type: none"> • Skeleton remains • Items associated with human burial, i.e. grave goods 	Full recording and recovering of human remains and associated features <ul style="list-style-type: none"> • Complete recoding by photography, drawing, written description • Full measurement of burial and surrounding matrix • Retrieval of human remains and associated materials • Retrieval of surrounding soil for further analysis
Intact features <ul style="list-style-type: none"> • Structural/architectural remains • Undisturbed context, such as hearth, midden, habitation area, assemblages of artefacts and/or environmental material 	Limited recording and recovery of archaeological features <ul style="list-style-type: none"> • Recording and measurement of salient features by photography, drawing and written description • Retrieval of all archaeological material • Retrieval of samples from the surrounding matrix
Intact artefacts <ul style="list-style-type: none"> • Complete objects such as pottery, metal objects, stone and bone tools. The objects are complete but isolated and are no part of assemblages or feature. 	Recovery of artefacts <ul style="list-style-type: none"> • Recovery of objects • Sampling of the surrounding matrix • Proper treatment with cleaning, marking and packing under international acceptable standards
Isolated material <ul style="list-style-type: none"> • Sherds, non-human bone, artefact fragments (metal, pottery, glass). There are no complete objects, the material is isolated and fragmentary in nature. 	Recovery of artefact fragments/archaeological material <ul style="list-style-type: none"> • Recovery of material, such as artefact fragments, environmental material and sampling of surrounding matrix
Deposits with archaeological potential <ul style="list-style-type: none"> • Soil deposits which exhibit characteristics associated with archaeological remains in Hong Kong 	Sampling of the deposit <ul style="list-style-type: none"> • Collection of soil samples from deposits displaying archaeological potential

Annex D

Implementation status on Environmental Protection Requirements

IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES

Table 1 Implementation Schedule of Air Quality Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
Air Quality - Construction Phase									
4.7.1		<p>In order that nuisance to air sensitive receivers is minimized, it is important to minimize dust emissions from construction activities including cut and fill operations and trucks movements on haul road.</p> <p>Dust control techniques should be considered to control dust to a level not exceeding the AQOs as well as the 1-hour TSP guideline level. These measures include:</p> <ul style="list-style-type: none"> • Adoption of good site practices; • Avoid practices likely to raise dust level; • Frequent cleaning and damping down of stockpiles, dusty areas of the Site and the haul roads; • Reduce the speed of the vehicles (say 10 kph) on the haul road; • Reducing drop height during material handling; • Provision of wheel-washing facilities for Site vehicles leaving the Site; • Regular plant maintenance to minimize exhaust emission; • If concrete batching plant or rock crushing plant is planned to be used, a license from EPD may be required depending on the total silo capacity since they are specified processes under the APCO. Modern plant should be designed to limit emissions 	Work site / during construction	All contractors		√		EIAO-TM, APCO, Air Pollution Control (Construction Dust) Regulation	Insufficient
									Insufficient
									Insufficient
									√
									√
									√
									As confirmed by Contractor, the concrete batching plant is not a specific process.
4.7.2		Providing watering four times a day for dust suppression.							Insufficient

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.
 ** D=Design, C=Construction, O=Operation; N/A = Not applicable

Table 2 Implementation Schedule of Water Quality Control Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
Water Quality – Construction phase									
6.11.4		<u>Proposed 18 holes Golf Course Layout Design</u> 20m buffer zones on both sides of the streams will be demarcated as a preventative mitigation measure to reduce the disturbance during construction phase of the golf course except for the portions of Streams A which is of low ecological value and an old tributary of Stream B. On one side of part of the Stream B, the buffer zone would be reduced to 5m.	Work site / During the construction period	All contractors		√		ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	√
6.11.5		For the construction activity which is unavoidable near natural streams (within the buffer zone), mainly the construction of crossings, preventative mitigation measures during the construction stage should be follow by the Contractor, they are shown as follows: <ul style="list-style-type: none"> The proposed works site inside or in the proximity of natural streams should be temporarily isolated, through by placement of sandbags or silt curtains and properly supported by props, to prevent adverse impacts on the stream water qualities; The natural bottom and existing flow in the stream should be preserved to avoid disturbance to the stream habitats; No direct and indirect discharge into the natural stream is allowed from any construction work activities; Stockpiling of construction material, if any, should be properly covered and located away from any natural stream; Monitor rain forecast closely and cover any exposed spoil when rainstorms are forecasted. Debris should be properly disposed of before rainstorm to avoid any inadvertent wash away into the stream; and removal of existing vegetation alongside the stream should be avoided. When disturbance to vegetation is unavoidable, all disturbed areas should be hydroseeded or planted with suitable vegetation to blend in with the natural environmental upon completion of works. 							Temporary drainage system provided on site was considered insufficient and ineffective.
6.11.13		<u>Runoff and Drainage Management</u> <ul style="list-style-type: none"> Diversion of upstream flows around the works areas for stream crossings and underground pipes: To minimize the impact of upstream runoff on the Works area by preventing storm flows reaching the work areas. This will be done through provision of upstream cut-off drains to intercept the flows and divert them around the Works area. It would convey flows to downstream stream courses, or other elements of temporary drainage systems (such as storage facilities). Temporary covering the works areas during severe storm events: Significant rainstorm events can be reasonably well forecast and when heavy rain is predicted, mitigation measures should be provided for the vulnerable areas by using tarpaulins, plastic sheets or other temporary covering to protect works area and minimize damage and erosion. It is recommended not to cover the newly establishment grass areas, and if unavoidable, this should only be done on a short term basis (less than 24 hours). Silt traps and sedimentation tanks for main discharge routes form works area: Sufficient and suitably sized silt traps and/or sedimentation tanks should be provided at the downstream ends of the systems to remove suspended solids prior to discharge. The discharge water quality shall be compliant with the <i>TM on Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters</i> under the WPCO. The required volume of the sedimentation tanks will depend on the catchment area served. Multiple tanks in series may also be required where runoff might be expected to be silty. The design details of the temporary drainage system at turf establishment area follow the same principles of the permanent drainage system. However the component pipes, tanks, lakes and/or pumps may differ in size, shape, location, etc. from that of the permanent system, dependent upon the temporary runoff areas as compared with those of the permanent system. Additionally or alternatively, the temporary drainage system may consist of other methods to control soil erosion and/or to facilitate the collection of surface water runoff. <p>The temporary drainage system will function during the period of time in which the permanent system is not yet completed. This circumstance will arise from the fact that the golf holes, inclusive of the permanent drainage system, will be constructed individually. As a result, the permanent drainage system may not be completed in its entirety until connection is made from each respective golf hole</p>	Work site / During the construction period	All contractors		√		ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	No revised TDMP was submitted the Contractor for RE and ET approval and comment during this reporting month. The latest submitted drainage plan is the mitigation measures for the silty runoff which has not included the recycling the runoff during the turf establishment. The wastewater treatment facility was not in operation during and after rain. Turfing area was completed at Holes 3-8, 11, 14 & 15. Chemical applications were required and applied during the reporting month. Sand capping was commenced at East course (Holes 10,12, 13 &16) and Hole 18 (central part of East course).

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
		<p>area to the lake/reservoir. As the permanent drainage system is completed for each hole, the corresponding temporary system will be decommissioned and reused elsewhere.</p> <p>The temporary drainage system will be in use until the permanent system is functional in a given area. Once the permanent system is functional in a given area, the temporary system will be decommissioned and, wherever possible, the components re-used in another temporary drainage system installed elsewhere. It is anticipated that the maximum duration of use for the temporary drainage system in any given area will be one-year.</p> <p>The storage tanks and/or lakes will be designed to segregate suspended solids (or pollutants as may be the case in plant/equipment storage and refueling areas) as may be necessary by contract requirements and reuse.</p> <ul style="list-style-type: none"> • No irrigation, fertilizer and pesticide applications to the turf would be permitted during rainstorm events or when heavy rainstorm is predicted 24 hours before the application. • Runoff from materials storage areas, particularly fuel and chemicals storage area should be separated from the main drainage systems (bundled, if necessary) and provided with dedicated facilities throughout the construction period, such as petrol interceptors. 							
6.11.14		<p>The Contractor shall follow good site practices and be responsible for the design, construction, operation, and maintenance of all the mitigation measures as specified in <i>ProPECC PN1/94</i> on construction site drainage through the construction period. These practices include:</p> <ul style="list-style-type: none"> • Temporary ditches should be provided to facilitate run-off discharge into appropriate watercourses, via a silt retention pond. • All drainage facilities and erosion and sediment control structures should be inspected monthly and maintained to ensure proper and efficient operation at all times. • Excavation of soil that cannot be avoided during the wet season, and exposed surface or open stockpiles should be covered with tarpaulin or other means. Other measures that need to be implemented before, during and after rainstorms are summarized in <i>ProPECC PN1/94</i>. • Exposed soil areas should be minimized to reduce potential for increase siltation and contamination of runoff. • Earthwork final surfaces should be well compacted and subsequent permanent work (turf establishment) should be immediately performed. • The Contractor shall contain within the site all surface runoff generated from the construction works, concreting works, dust control and vehicle washing, etc. • The Contractor shall arrange other measures, such as provision of sand bags or temporary diversion systems to prevent washing away of soil, silt or debris into any nearby natural streams. Any runoff shall be diverted into appropriate sediment traps before discharging to the nearby drainage system. The discharge water quality shall be compliant with the <i>TM on Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters</i> under the WPCO. • The Contractor shall observe and comply with the Water Pollution Control Ordinance (WPCO) and its subsidiary regulations by implementing environmental protection measures (such as the use of silt traps) and preventing any point or non-point source of pollution. 	Work site / During the construction period	All Contractor		√		ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	Same as above

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
6.11.15		<p><u>Concrete bridge construction</u></p> <p>No work is allowed to come into contact with the underlying stream bed during the concrete bridge construction. During the construction of precast concrete bridge, if necessary, precaution measures should be taken to ensure no potentially polluting liquid or solid wastes fall into the stream. This is essential to avoid water quality impacts within ecologically sensitive streams.</p> <p>The Contractor shall good site follow practices, including, but no limited to::</p>	Work site / During the construction period	All contractors		√		ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	Construction of all permanent bridges was completed before March 2007. Decking/finishing work of all bridges was in progress during the reporting month.
6.11.16		<ul style="list-style-type: none"> Construction work area for the precast concrete should be outside the designated stream buffer zone area; The designated work area for precast concrete work should be covered to minimize the potential water runoff during rain from the construction area; All water used within the concrete work area should be collected, stored and recycled to reduce resource consumption. Stormwater runoff from the works areas fro precast concreting works should drain under gravity towards a sedimentation basin. The overlying water from the sedimentation basin should be recycled for reuse within the plant. The deposited sediment should be dewatered and the dry matter should require disposal off-site. No water should be discharged outside the boundary of the precast concrete works area; The use of tarpaulin sheet or other means (water impermeable texture) should be placed beneath precast concrete beam level (must be above the stream bed level) to capture any falling object during installation of precast concrete bridge on the footings or abutments; Prohibition of any direct and indirect discharge into the streams; The concrete bridge and footings of abutments must be completely above the high water mark; All equipment and machinery must be free of leaks or excess oil and grease; Equipment refueling or servicing or storage of fuel must be undertaken at a minimum of 30 meters from the stream; Prevent soil and trash from getting into stream during construction by use of silt fence, fiber rolls, gravel bags and other effective means; All bare soil (abutment slope or temporary stockpile) must be covered with tarpaulin or other means before forecast rain; and Wash out concrete trucks or pumps only into designated washout pits. 							
6.11.19		<p><u>Dredging during Construction of Desalination Plant's intake and outfall</u></p> <p>The intake and outfall pipelines will be constructed by dredging the seabed to form a trench and backfilled with a layer of bedding material (quarry run stone) before putting the pipelines in place. Once in place, the pipelines are covered with layers of rock armour on top of the pipelines to protect the pipelines against damage by wave action. The alternative backfilling material is from rock excavated during site formation if suitable.</p>	Work site / During the construction period	All contractors		√		ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	No dredging work for the desalination plant pipelines was carried out. All desalination plant land formation work and temporary pipelines were completed and installed at the existing KSC pier during the reporting month. Application of the discharge licence of the desalination plant was on-going.
6.11.20		<p>The materials used for the backfilling at the intake and outfall pipelines are stone and rock armour only. Transfer of backfilling materials onto the seabed from barge should be conducted by careful grabbing and unloading to seabed (to minimize sediment migration), thereby minimize impacts on water quality to nearby water sensitive receivers. As a preventative measures, silt curtain will also be required during the backfilling activities. The expected backfilling duration is approximate 2 months.</p>							
6.11.21		<p>The Contractor shall use backhoe for dredging works at a water depth of less than 2m and use close grab dredger for works with water depth of more than 2m. The estimated dredging works is about 50m long (where backhoe should be used for water less than 2m deep) and 70m long (where close grab dredger should be used for water more than 2m deep). Only one dredging method should be used at any one time.</p>							
6.11.22		<p>In order to avoid pollution during dredging, transporting and dumping of marine mud. Pollution avoidance measures shall include but not be limited to the following:</p> <ul style="list-style-type: none"> The maximum daily dredging rate for closed grab dredger should be 45m³/day; The maximum daily dredging rate for backhoe should be 20m³/day; Silt curtain should be installed for any dredging methods to protect the WSRs; Closed grabs or sealed grabs should only be used for locations with water depths ≥ 2m; Backhoe should only be used for locations with water depths ≤ 2m; All equipment should be designed and maintained to minimise the risk of silt and other contaminants being released into the water column or deposited in locations other than designated location; 							

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
6.11.23		<ul style="list-style-type: none"> Mechanical grabs should be designed and maintained to avoid spillage and should seal tightly while being lifted; No trailing suction hopper dredgers would be deployed for the dredging of marine mud; All vessels should be sized such that adequate clearance is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; All pipe leakages should be repaired promptly and plant shall not be operated with leaking pipes; Before moving the vessels which are used for transporting dredged materials excess material should be cleaned from the decks and exposed fittings of vessels and the excess materials should never be dumped into the sea except at the approved locations; Adequate freeboard should be maintained on barges to ensure that decks are not washed by wave action; The Contractor should monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The contractor should keep and produce logs and other records to demonstrate compliance and that journey times are consistent with designated locations and copies of such records should be submitted to the engineer; All bottom dumping vessels should be fitted with tight fitting seals to their bottom openings to prevent leakage of material; Loading of barges and hoppers should be controlled to prevent splashing of dredged material to the surrounding water, and vessels should not be filled to a level which will cause overflowing of material or polluted water during loading or transportation; and The engineer may monitor any or all vessels transporting material to check that no dumping outside the approved location nor loss of material during transportation takes place. The contractor should provide all reasonable assistance to the engineer for this purpose. <p>In addition, baseline water quality monitoring before commencement of the marine works shall be carried out in the nearby waters to obtain baseline information for subsequence monitoring. Regular and frequent water quality monitoring shall be carried out throughout the whole construction period to ensure the water quality during construction is well within the established environmental guidelines and standards.</p>							
6.11.24		<p>Silt Curtain</p> <p>In order to minimize impacts during the whole construction period of desalination plant's intake and discharge outfall, silt curtains should be utilized to minimize sediment migration. The Contractor shall be responsible for the design, installation and maintenance of the silt curtains to minimize the impacts on the water quality and the protection of water sensitive receivers. The design and specification of the silt curtains shall be submitted by the Contractor to the Engineer for approval. Area of the silt curtain to enclose the works area should be minimized in order to reduce the disturbance of ecological sensitive areas nearby.</p>							
6.11.25		<p>A typical suspended solids reduction of 75% can be achieved with the incorporation of silt curtain. Two-layer silt curtains have generally been used for dredging projects of larger scale to further ensure this reduction. However, as the scale of proposed project is considered small, it is recommended to use single layer silt curtain which can achieve a minimum 75% suspended solids reduction.</p>							
6.11.26		<p>Silt curtains shall be formed from tough, abrasion resistant, permeable membranes, suitable for the purpose, supported on floating booms in such a way as to ensure that the sediment plume shall be restricted to within the limit of the works area.</p>							
6.11.27		<p>The silt curtain shall be formed and installed in such a way that tidal rise and fall are accommodated, with the silt curtains always extending from the surface to the bottom of the water column. The removal and reinstallation of such curtains during typhoon conditions shall be as agreed with the Director of Marine Department.</p>							
6.11.28		<p>The Contractor shall regularly inspect the silt curtains and check that they are moored and marked to avoid danger to marine traffic. Any damage to the silt curtain shall be repaired by the Contractor promptly and the works shall be stopped until the repair is effected to the satisfaction of the Engineer.</p>							

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
6.11.29		<u>General Construction Activities</u> Debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering adjacent watercourse. Stockpiles of construction materials should be kept covered when not being used.	Work site / During the construction period	All contractors		√	ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	No construction waste was disposed off-site was reported. Coverage of waste wasn't observed.	
6.11.30		Oils and fuels should only be stored/handled in designated areas with pollution prevention facilities. Oil interceptors need to be regularly inspected and cleaned to avoid wash-out of oil during storm conditions.						Not observed	
6.11.32		All fuel tanks should be provided with locks and be sited on sealed areas within bunds of capacity equal to 110% of the storage capacity of the largest tank.						√	
6.11.33		Good housekeeping practices and staff training are required to minimize careless spillage and keep the work space in a tidy and clean conditions at all times. Accidental spillage of chemicals in the works area would directly affect the aquatic environment. It is recommended that the Contractor should develop management procedures for chemical and implement an emergency plan to deal with chemical spillage in case of an accident.	Work site / During the construction period	All contractors		√	ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	No observed	
6.11.34		Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The chemical waste should be transported to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes details the requirements to deal with chemical wastes.						No chemical waste disposal recorded was submitted by the Contractor. The chemical waste storage area was moved to Hole 17 during the reporting month. The chemical storage area was located at Hole 18.	
6.11.35		<u>On-Site Sewage Effluents</u> In order to prevent sewage effluents affecting water courses, the following mitigation measures should be provided by the Contractor:- <ul style="list-style-type: none"> Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site to handle sewage from the workforce; The toilet facilities should be more than 30 m from any watercourse; Temporary storage tank should be provided to collect wastewater from kitchens or canteen, if any; A licensed waste collector should be deployed to clean the chemical toilets on a regular basis which will be and disposed of at government sewage treatment facilities <ul style="list-style-type: none"> Regular environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site. It is anticipated that sewage generation during the construction phase of the project would not cause water pollution problem after undertaking all required measures; and Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the project. 						√. A sewage treatment plant was provided at the site office. Approximate five mobile toilets were available on site at southern portion of the construction site. The Contractor was disposed the temporary stored sewage effluent off-site by licenced Contractor during the reporting month. No canteen was available. √ √	
								No observed	
6.11.36		<u>Concrete batching plant</u> All water used within the concrete batching plant will be collected, stored and recycled to reduce resource consumption. This includes water used in the concrete batching process, truck cleaning, yard washing and dust suppression spraying. All spent dust suppression effluent will be collected and recycled. To minimize the potential water quality impacts that may generate from the concrete batching plant, a drainage system should be provided in this site. The batching plant area should be channelled to collect concrete washings for further treatment before reuse on-site and prevent concrete washings from directly entering the any stream or seawater. Site runoff should also be collected through the drainage system. To minimize the generation of contaminated site runoff from concrete production area, the concrete batching plant should be sheltered.	Work site / During the construction period	All contractors		√	ProPECC PN 1/94; WPCO; TM-Effluent Standards for Effluents Discharged into Drainage and Sewerage Systems, Inland and Coastal Water	The concrete batching plant was operating and being dismantled during the reporting month. There was a sedimentation pit within the concrete batching plant area to collect the wastewater and used as a wheel waste facilities. The collected water will pump to sedimentation columns for recycle use. No discharge was expected from the plant. The site condition of the concrete batching plant was satisfactory.	
6.11.37		Concrete washings and site runoff should be pumped to a wastewater treatment system with a sedimentation unit for removal of suspended solids such as waste concrete particles, silt and grit in order to achieve the discharge standards. pH adjustment should also be applied if the pH value of the collected concrete washings and site runoff is higher than the pH range specified in the discharge licence. This can be achieved by adding neutralizing regents, i.e. acidic additive. A discharge licence should be applied from EPD for discharge of effluent from the site. Analysis of effluent quality may be required as one of the licensing conditions of the discharge licence. The Contractor should collect effluent samples at the final discharge point in accordance with the required sampling frequency to test the specified water quality parameters. The quality of the discharged effluent should comply with the discharge licence requirements.							

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location	Implementation Agent	Implementation Stages**			Relevant Legislation and Guidelines	Implementation Status
					D	C	O		
6.11.38		It is recommended to reuse the treated effluent for dust suppression and general cleaning on site, wherever possible.							
6.11.39		The drainage system should be maintained on a regular basis to remove the deposits on the channels. The sedimentation and pH adjustment systems should also be checked and maintained by competent persons to ensure that the systems are functioning properly at all times.							
6.11.40		The deposited sediment will be dewatered and the dry matter will require disposal off-site. The estimated maximum concentrate batching operation period during construction is 20 months.							
6.11.41		Sand, gravel and other bulk materials will be delivered from the production area by conveyor boats or derrick barges to the temporary barging point, and the material will then be loaded onto dump trucks by loaders and delivered to the on-site storage areas.							
		Regular environmental inspections should be conducted to check the environmental performance of daily operation. These inspections will ensure proper installation and maintenance of pollution control measures, such as checking of sedimentation basin, wastewater recycling facility and enclosure of stockpiles, and the implementation of other mitigation measures.							

* All recommendations and requirements resulted during the course of EIA/EA Process, including ACE and/or accepted public comment to the proposed project.

** Des - Design, C = Construction, O = Operation

N/A Not applicable

Table 3 Implementation Schedule of Waste Management Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
Waste Management - Construction Phase									
7.7.2		<p>Good site practice to minimize solid waste generation, including:</p> <ul style="list-style-type: none"> nomination of approved personnel, such as a site manager, to be responsible for good site practices, and making arrangements for collection of all wastes generated at the site and effective disposal to an appropriate facility; training of site personnel in proper waste management and chemical waste handling procedures; provision of sufficient waste disposal points and regular collection for disposal; appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors; a Waste Management Plan should be prepared and should be submitted to the Engineer for approval. One may make reference to ETWB TCW No. 15/2003 for details; and a recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be proposed. 	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance; The Land (Miscellaneous Provisions) Ordinance; ETWB TCW NO. 15/2003.	No construction waste was disposed off-site by the Contractor during this reporting month. No domestic waste disposal recorded was submitted by the Contractor during the reporting month.
7.7.4		<p>Good management and control can prevent the generation of significant amounts of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; separate labelled bins shall be provided to segregate aluminium cans from other general refuse generated by the work force, and to encourage collection of by individual collectors; any unused chemicals or those with remaining functional capacity shall be recycled; maximising the use of reusable steel formwork to reduce the amount of C&D material; prior to disposal of C&D waste, it is recommended that wood, steel and other metals shall be separated for re-use and / or recycling to minimise the quantity of waste to be disposed of to landfill; proper storage and site practices to minimise the potential for damage or contamination of construction materials; plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste; minimize over ordering of concrete, mortars and cement grout by doing careful check before ordering. 	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance; The Land (Miscellaneous Provisions) Ordinance; ETWB TCW NO. 15/2003.	<p>Not observed</p> <p>Not observed</p> <p>Not observed</p> <p>√</p> <p>Not observed</p> <p>Not observed</p> <p>√</p> <p>√</p>
7.7.6		<p><u>Site Clearance Waste</u> Scrub and other vegetation will be stripped for the tees, fairways, greens and access roads. The normal route for disposal for such material is landfill but in this case it is proposed that vegetation is passed through a "chipper" to break down the material into a medium that can be used as mulch / compost and provide a seed-bank for natural hydroseeding of exposed areas.</p>	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance ; The Land (Miscellaneous Provisions) Ordinance; ETWB TCW NO. 15/2003.	All vegetated area within the construction area was removed and disposed off-site in March 2007.
7.7.7		<p>Non-inert materials should be kept separate and reused on-site as fill in preference to disposal at public filling areas which are operated by CEDD or disposal at landfill.</p>							√
7.7.8		<p><u>Excavated Materials</u> Material generated during open cut works, and access route formation will comprise rock and soil and all this material will be reused in the site shaping process. It is anticipated that there will be no material requiring disposal off-</p>	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance; The Land (Miscellaneous Provisions) Ordinance;	√

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
		site in public filling areas.						ETWB TCW NO. 15/2003.	
7.7.9		<u>Construction and Demolition (C&D) Material</u> The C&D material generated from the site formation and demolition works should be sorted on-site into inert C&D material and C&D waste. In order to minimise the impact resulting from collection and transportation of C&D material for off-site disposal, the excavated material comprising fill material should be reused on-site as backfilling material. C&D waste, such as wood, plastic, steel and other metals should be reused or recycled and, as a last resort, disposed of to landfill. A suitable area(s) should be designated within the site for temporary stockpiling of C&D material and to facilitate the sorting process. The stockpiling/sorting area should be located far away from the identified sensitive receivers.	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance; The Land (Miscellaneous Provisions) Ordinance; ETWB TCW NO. 15/2003.	Accumulated construction waste stockpile at Hole 2 were not disposed offsite during the reporting month.
7.7.10		<u>Site fencing</u> Some site fencing may be required. Attention should be paid to WBTC No. 19/2001 which introduces a new policy requiring the use of metallic site hoardings and signboards in order to reduce the amount of timber used on construction sites.	Work site / During the construction period	All Contractors		√		WBTC No. 19/2001	Only some of the area was installed fencing (geotextile/metallic hoarding) was provided on site.
7.7.12		<u>Chemical Waste</u> Where the construction processes produce chemical waste, the Contractor must register with EPD as a Chemical Waste Producer. Wastes classified as chemical wastes are listed in the <i>Waste Disposal (Chemical Waste) (General) Regulation</i> . These wastes are subject to stringent disposal routes. EPD requires information on the particulars of the waste generation processes including the types of waste produced, their location, quantities and generation rates. A nominated contact person must be provided.	Work site / During the construction period	All Contractors		√		Waste Disposal (Chemical Waste) (General) Regulation	No submission on the chemical waste disposal record was received since the commencement of this project.
7.7.14		Hard standing surfaces draining via oil interceptors shall be provided in works area compounds. Interceptors will be regularly emptied to prevent release of oils and grease into the surface water drainage system after accidental spillages. The interceptor should have a bypass to prevent flushing during periods of heavy rain. Oil and fuel bunkers should be banded to prevent discharge due to accidental spillages or breaches of tanks. Waste collected from any grease traps should be collected and disposed of by a licensed contractor.							
7.7.15		Any construction plant which is likely to leak oil, should have absorbent inert material e.g. sand, placed beneath it. This material should be replaced on a regular basis and the contaminated material should be stored in a designated, secure place. Any sand used for soaking oil waste is classified as chemical waste and should be disposed of in accordance with the <i>Waste Disposal (Chemical Waste) (General) Regulations</i> .							
7.7.16		Lubricants and waste oils are likely to be generated during the maintenance of vehicles and mechanical equipment. Used lubricants will be collected and stored in individual containers which are fully labelled. The containers should be stored in a designated secure place. If possible such waste should be sent to oil recycling companies; there are also companies which collect empty oil drums for reuse or refill.							
7.7.17		Oil and lubricant wastes are classified as chemical wastes, and if not recycled, should be collected by licensed collector and should be treated at the Chemical Waste Treatment Centre, Tsing Yi, or other sites licensed for disposal of waste oil. A trip ticket system operates to control the movement of such chemical waste and tickets have to be produced upon the request of EPD.							
7.7.18		Some paints and solvents are classified as chemical waste and, if used on site, will be subject to the stringent requirements of the <i>Waste Disposal (Chemical Waste) (General) Regulation</i> . Empty paint cans should be							

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
7.7.19		recycled or collected as waste. Any dry paint waste should be swept up and collected in containers for disposal. No lubricants, oils, solvents or paint products should be allowed to discharge into water courses, either by direct discharge, or as contaminants carried in surface water runoff from the construction site.							
7.7.20		<u>Sewage</u> An adequate number of portable toilets should be provided for the on-site construction workforce. The portable toilets shall be maintained in a state that will not deter the workers from using them.	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance; The Land (Miscellaneous Provisions) Ordinance; ETWB TCW NO. 15/2003.	Few portable toilets were available at remote area to the site office. Site office with provision of flushing toilets for workers and staffs.
7.7.21		<u>General Refuse</u> General refuse should be stored in enclosed bins or compaction units separate from C&D material. A reputable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D material. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material.	Work site / During the construction period	All Contractors		√		WDO; Public Health and Municipal Services Ordinance; The Land (Miscellaneous Provisions) Ordinance; ETWB TCW NO. 15/2003.	The disposal should be on weekly basis (confirmed by CHEC). However, submitted records by the Contractor were on monthly basis at least.
7.7.22		Solid and liquid wastes will be generated by the construction workers during the clearance/construction period. The refuse (mainly non-recyclable materials) will be collected regularly in black refuse bags and delivered to the existing solid waste disposal system and transferred to landfill for disposal.							
7.7.23		<u>Marine Sediments</u> The basic requirements and procedures for dredged mud disposal are specified under the ETWB TCW No. 34/2002. The management of the dredging, use and disposal of marine mud is monitored by the Marine Fill Committee (MFC), while the licensing of marine dumping is the responsibility of the Director of Environmental Protection (DEP). The dredged marine sediments will be loaded onto barges and transported to the designated disposal site.	Marine Dredging area / During the construction period	All Contractors		√		ETWB TCW NO. 34/2002.	No dredging works was carried out during the reporting month. No dumping licence was applied by the Contractor.
7.7.25		During transportation and disposal of the dredged marine sediments, the following measures should be taken to minimise potential impacts on water quality: <ul style="list-style-type: none"> Bottom opening of barges shall be fitted with tight fitting seals to prevent leakage of material. Excess material shall be cleaned from the decks and exposed fittings of barges and hopper dredgers before the vessel is moved. Monitoring of the barge loading shall be conducted to ensure that loss of material does not take place during transportation. Transport barges or vessels shall be equipped with automatic self-monitoring devices as specified by the DEP. 							

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.

** D=Design, C=Construction, O=Operation; N/A = Not applicable

Table 4 Implementation Schedule of Ecological Impact Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
Construction Phase									
8.7.1		<u>Terrestrial Ecology</u> Haul roads would be located on future fairway and cart paths alignments to minimise temporary disturbance of habitats.	Work site / During the construction period	All Contractor		√		-	√
8.6.39		Avoid disturbance of stream bed during the construction of the permanent bridges by using precast unit of the bridge segments transported from other locations and installed to the proposed locations.	Stream crossing/ During the construction period	All Contractor		√		-	√
8.7.4		Good site practice. Construction materials must be stored at locations away the stream courses. Site runoff would be desilted in settling ponds to reduce the potential for suspended sediments, organics and other contaminants to enter stream and marine environment.	Work site / During the construction period	All Contractor		√		-	Heavy silt deposit was observed at Streams A, B, C after rain. Temporary drainage system provided on site was considered insufficient.
8.9	Table 4.1	Streams B, C, and D will be monitored monthly during the construction phase to determine the status of <i>Caridina trifasciata</i> (shrimp) and <i>Nanhaipotamon hongkongensis</i> (freshwater crab). Stream condition will be recorded with reference to the protective buffer zone. Encroachment onto the buffer zone will be reported to the ER/ET. Sheet piling will be installed at the buffer zone perimeter as needed to prevent further encroachment. Stream sedimentation will be reported to the ER/ET, the agent causing sedimentation will be discovered, and sedimentation will be stopped.	Stream B, C & D/ During the construction phase	All Contractor		√			Monitoring has been carried out during this reporting month. There were small amount of artificial rocks filling sitting on the stream bed of downstream A during this reporting month. Heavy silt deposit was observed at Streams A, B, C after rain. Low abundance of <i>Caridina trifasciata</i> (shrimp) was observed at Streams B and C during the ecology survey.
9.7.22		<u>Marine Ecology</u> The temporary drainage system, which would receive flows from all areas subject to earth works, would collect all site runoff. The collected runoff would be retained for turf grass irrigation.	Work site / During the construction period	All Contractor		√			On-going
9.8.5		Dredging for the two pipelines for the desalination plant would be require 50 days and would be scheduled to the extent possible from January to April 2006. This would avoid the flowering season for the seagrass <i>Halophila ovalis</i> , i.e. November and December (Fong et al. 2005) and the spawning season for corals, i.e. July to October (Lam 2000; Storlazzi, C. D. 2004).	Dredging area/ during dredging period	All Contractor		√			N/A
9.8.2	4.2.12	Coral colonies within the silt curtain, in particular the 79 colonies identified during the coral mapping survey, (see Appendix A9.2) would be transplanted. Prior to commencement of any marine construction works for the proposed project, the affected coral colonies would be tagged using plastic labels and a number would be assigned to each. The tagged corals in the dredging area at D2 site will be transplanted to the bedrock area about 80 m south of the ferry pier. All these transplantation works should be conducted by experienced marine ecologist(s) and should be completed before the commencement of marine construction works.	Dredging area/Prior to dredging	All Contractor		√			Coral transplantation at Site D2 was completed in Dec 2006. One year of transplanted corals monitoring on quarterly basis was commenced in Dec 2007 and will be completed in Dec 2007.
9.8.5		Silt curtains will be deployed during dredging for the desalination plant. With the deployment of silt curtains around the dredging area for the desalination plant, adverse water quality impacts associated with the dredging and backfilling would be controlled to acceptable levels.	Dredging area/Prior to dredging	All Contractor		√			N/A
		All anchoring points/structures of the floating pier would be located on the shore and/or at least 40m seaward to avoid the coral colonies at Site B2 which are concentrated within the first 15m seaward from the coastline and none recorded over 35m seaward.	Temporary barging point/ during construction of the barging point	All Contractor		√			Floating pontoon was located at designated location according to EP during the reporting month.
		The location of the floating pier would also be shifted from the original location for barging point at Zone 2 and Zone 3 of the mapping area in Site B2 (see Figure 2 in Appendix A9.2), to Zone 5 to further protect corals. Impacts to corals are not expected.	Temporary barging point/ during the entire construction phase	All Contractor		√			√

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.

** D=Design, C=Construction, O=Operation

N/A Not applicable

Table 5 Implementation Schedule of Fisheries Impact Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
10.8.2		<u>Construction phase</u> In addition to the temporary drainage system which would collect site runoff for re-use for irrigation, site runoff would also be controlled by general site practices during the construction period.	Work site / During the construction period	All Contractor		√		N/A	Not observed
10.8.3		Silt curtains will be deployed during dredging for the desalination plant. With the deployment of silt curtains around the construction area, adverse water quality impacts associated with the dredging and back-filling would be controlled.	Work site / During the construction period	All Contractor		√		N/A	No dredging work for the desalination plant was carried out during the reporting month.
10.7.12		The majority of the heavy construction works, in particular, the cut and fill earth works, would be conducted within the 2005-2006 dry season.	Work site / During the construction period	All Contractor		√		N/A	Master Programme (not approved by Jockey Club) indicated that excavation will carried out throughout the year 2006 to late 2007.

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.

** D=Design, C=Construction, O=Operation

N/A Not applicable

Table 6 Implementation Schedule of Landscape and Visual Impact Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
Landscape and Visual Impact - Construction Phase									
Table 12.13	MC1	Site offices and construction yards: • Site offices and the construction yard shall be decommissioned after construction. • Haul roads shall be decommissioned and restored with hydroseeding works after construction.	All site offices	All contractors		√		EIAO Guidance Note No. 8/2002	To commence
Table 12.13	MC2	Height of site offices: • The height of site offices shall be controlled in order to avoid visual impacts.	All site offices	All contractors		√		EIAO Guidance Note No. 8/2002	Complied. A two-storey high site office painted in green color has been constructed.
Table 12.13	MC3	Hoarding and screening: • Where practical the site offices areas, construction yards and storage areas shall be screened using olive green coated hoarding or vegetation around the peripheries of the works area until the completion of relevant construction phases.	All site office and construction yard areas.	All contractors		√		EIAO Guidance Note No. 8/2002	Complied. Green hoarding erected.
Table 12.13	MC4	Construction plant and building material: • Shall be orderly and carefully stored in order to appear neat and avoid visibility from outside where practical; • Excess materials shall be removed from site as soon as practical; • All construction plant shall be removed from site upon completion of construction works.	In all construction yards.	All contractors		√		EIAO Guidance Note No. 8/2002	Complied.
Table 12.13	MC5	Construction light: • To be oriented away from the viewing location of VSRs; and • All lighting shall have frosted diffusers and reflective covers. • While construction at night might be required from time to time, this should be controlled and minimised.	All construction lights.	All contractors		√		EIAO Guidance Note No. 8/2002	No construction lights at present.
Table 12.13	MC6	Vegetation: • Temporary construction sites shall be restored to standards as good as, or better than, the original condition. In this respect, areas that are not covered by golf course grassing works shall be hydro seeded; • The potential for soil erosion shall be reduced at the construction stage by minimizing the extent of vegetation disturbance on site and providing a protective cover over exposed ground; and • No plant or building materials shall be stored under the dripline of retained trees and no vehicle movement or other construction activities like washing, concrete mixing etc shall be carried out under the dripline of trees.	All temporary construction sites.	All contractors		√		EIAO Guidance Note No. 8/2002	Hydroseeding has been carried out for erosion control. Small scale erosion occurred. Does not comply. Building material has been stored under dripline of trees.
Table 12.13	MT1	Compensation for losses: • The tree compensation to tree loss ratio shall be between 1:2 and 1:3; • At least 700 new trees shall have be of light standard or larger size.	As shown on mitigation measures plans.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: To commence.
Table 12.13	MT2	The majority of compensation species shall comprise species that already occurs within the LIA boundaries;	General.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied. Construction Stage: To commence.
Table 12.13	MT3	Where practical, trees that require removal shall be transplanted on Site;	General.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Partial completed of transplantation works on site.
Table 12.13	MT4	New trees shall be planted in groups in order to screen visual impacts and to provide additional shade at the administration building, rain shelters and halfway houses.	As shown on mitigation measure plans.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: To commence.

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
Table 12.13	MT5	Tree Planting on Slopes: • New slopes with a gradient larger than 30° shall have whip tree planting. • Such whip trees shall comprise tree species with shrub-like characteristics, such as <i>Gordonia axillaries</i> (大頭茶) and <i>Raphiolepis indica</i> (車輪梅).	General.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Shrubs planting are being carried out on slopes.
Table 12.13	MT6	Tree planting works at the hill where the desalination plant will be located shall be carefully positioned in order to represent its original profile.	At the desalination plant.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: To commence.
Table 12.13	MT7	Tree Preservation: • No tree shall be transplanted or felled without prior approval by relevant Government departments in accordance with WBTC 24/94, WBTC 14/2002 and ETWB 2/2004; • All trees that are marked for retention shall be fenced off with a 1.2m high fence around the dripline of trees or larger area; • Transplant preparation works shall be carried as soon as possible after commencement of construction. Rootball and crown pruning shall be carried out over at least 1 month.	All areas with existing trees	All contractors	√	√		WBTC 24/94, WBTC 14/2002, ETWB 2/2004	Design Stage: Tree felling approved.
Table 12.13	MT8	Buffer Areas • For streams the width of the buffer zones will be 20m from the stream bank. The only exception would be the buffer zone in the reach of upper tributary of stream B lying between the two parts of Hole 10, where the buffer will zone will be 5m, the dry tributary of stream B that will be converted to an underground culvert and the secondary tributary of stream A that will also be converted to an underground culvert. • No construction activities will be allowed in the buffer zones, except for site formation works, which are required for the construction of bridge footings.	At streams	All contractors	√	√		EIAO Guidance Note No. 8/2002	
Table 12.13	MS1	Bulk hydroseeding: • Bulk site formation works shall be followed with bulk hydroseeding as soon as practical.	General.	All contractors		√		EIAO Guidance Note No. 8/2002	
Table 12.13	MS2	Grassing: • In the case of golf course areas, grassing shall be carried out as soon as practical after sanding and shaping; and • Sanding, shaping and grassing works shall be phased in sections.	At proposed grassing areas.	All contractors		√		EIAO Guidance Note No. 8/2002	Construction Stage: Some trees were found damaged or dead. Tree transplantation commenced.
	MS3	Restoration: • In the case of residual areas that were disturbed during construction, which will not be part of the golf course areas, detailed site formation works and shaping shall be followed by hydroseeding and shrub planting as soon as practical; and • The hydroseeding mix shall be composed of the following grass species: <i>Eragrostis curvula</i> <i>Lolium Perenne</i> <i>Neyraudia reynaudiana</i> <i>Pennisetum purpureum</i> ; and the following shrub / small tree species: <i>Gordonia axillaries</i> , <i>Raphiolepis indica</i> and <i>Rhodomyrtus tomentosa</i> .	At all residual areas.	All contractors		√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: No works in buffer areas at present.
Table 12.13	ME1	Screening: • Bridges and pumping stations shall be screened by tree and shrub planting; and • Retaining wall shall be covered with climber plants.	All bridges and pumping stations.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Hydroseeding commenced.
Table 12.13	ME2	Abutments of bridges shall be surfaced with stone of volcanic origin with a colour and texture similar to that of rock in the surrounding landscape;	All bridges.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Being Carried Out.
Table 12.13	ME3	Above-ground walls and foundations of pumping stations shall be surfaced with stone of volcanic origin with a colour and texture similar to that of rock in the surrounding landscape.	All pumping stations.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Completed. Additional Shrubs is Required to Satisfy the Spacing Requirement.

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages**			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
Table 12.13	ME4	Above-ground covers of pumping stations shall have an olive green coating.	All pumping stations.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: To commence.
Table 12.13	ME5	The desalination plant shall be located within the hill behind the pier. Slope cutting of this hill shall have a natural appearance with hydroseeding cover.	As shown on the mitigation measure plans.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Completed.
Table 12.13	ME6	Water tanks shall be located below surface level. Above-ground components shall be coated in olive green.	All water tanks.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: To commence.
Table 12.13	MB1	Extensions of the clubhouse shall have a surface cover that is in visual harmony with the clubhouse itself.	All new extensions of the clubhouse.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: In Progress.
Table 12.13	MB2	Shrub planting shall be implemented in front of the new golf cart parking area in order to screen low-level views.	The new golf cart parking area.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Desalination Plants Has Been Constructed. Landscape Work to Be Commenced.
Table 12.13	MB3	Tree and shrub planting shall be implemented on the peripheries of the maintenance building and its extensions.	At the maintenance building.	All contractors	√	√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: In Progress.
Table 12.13	MB4	Halfway houses and rain shelters shall be surfaced with either stone or beige and olive green paint.	At all halfway houses and rain shelters.	All contractors		√		EIAO Guidance Note No. 8/2002	Design Stage: Complied Construction Stage: Completed.

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.
** D=Design, C=Construction, O=Operation
N/A Not applicable

Table 7 Implementation Schedule of Cultural Heritage Mitigation Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages **			Relevant Legislation & Guidelines	Implementation Status
					D	C	O		
Construction Phase									
Table 13.4		Wan Chai Archaeological Site - Archaeological Watching Brief	Site formation and construction works	All Contractors		√		EIAO	Watching brief at Hole 2 was completed in February 2007.
Table 13.4		Grave #1 – Preservation in-situ - Fenced off three metre buffer zone around the grave	Site formation and construction works	All Contractors		√		EIAO	Buffer zone fencing was provided around at Grave 1.
Table 13.4		Grave #5 - Preservation by record; and recovery of structural elements (if required by AMO)	Construction phase (prior to commencement of works)	All Contractors		√		EIAO	The revised golf course design will not disturb the Grave 5 and will keep in-situ. No preservation record for this grave is required.
Table 13.4		Grave #20 - Preservation by record; and recovery of structural elements (if required by AMO)	Construction phase (prior to commencement of works)	All Contractors		√		EIAO	The preservation by record was completed in 23 rd October 2006 and submitted to AMO for record.
Table 13.4		Any, as of yet unidentified graves at Kap Lo Kok. If a grave is found works will stop in the immediate vicinity of the grave until it can be inspected by AMO staff.	Site formation and construction works	All Contractors		√		EIAO	√

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.

** D=Design, C=Construction, O=Operation

N/A Not applicable

Table 8 Implementation Schedule of Land Contamination Mitigation Measures

EIA Ref	EM&A Ref	Environmental Protection Measures*	Location / Timing	Implementation Agent	Implementation Stages **			Relevant Legislation & Guidelines	Implementation status
					D	C	O		
Land Contamination - Construction Phase									
11.9.2		<p>Since the exact cut areas on site during construction by the Contractor have not been determined at this stage, the Contractor should implement the suitable precautions and preventive measures for the discovery of buried or abandoned ordnance during the construction. Moreover, it is recommended that standard good practice should be implemented during the construction phase in order to minimize any potential exposure to contaminated soils or groundwater. These measures include:</p> <ul style="list-style-type: none"> • The Contractor should sweep the area of intended excavation with a metal detector to check any ordnance underneath the ground prior to any excavation. • For any detection of metals under the ground, the Contractor should cease work immediately before confirming the identity of the cause. For any suspect of artillery ordnance, Hong Kong Police Force should be informed. • The use of bulk earth-moving excavator equipment would minimise construction workers' potential contact with the contaminated materials; • Exposure to any contaminated materials can be minimised by the wearing of appropriate clothing and personal protective equipment such as gloves (when interacting directly with suspected contaminated material), providing adequate hygiene and washing facilities and preventing smoking and eating during such activities; • Stockpiling of contaminated soil should be avoided. If this cannot be avoided, the stockpile of contaminated materials should be segregated from the uncontaminated ones. Moreover, the contaminated materials should be properly covered with waterproof material (e.g. tarpaulin sheet) to avoid leaching of contaminants, especially during rainy season. • Vehicles containing any excavated materials should be suitably covered to limit potential dust emissions or contaminated wastewater run-off, and truck bodies and tailgates should be sealed to prevent any leakage during transport or during wet conditions; • Only licensed waste haulers should be used to collect and transport any contaminated material to an appropriate disposal site and procedures should be developed to ensure that illegal disposal of waste does not occur; • Necessary waste disposal permits should be obtained, as required, from the appropriate authorities, in accordance with the <i>Waste Disposal Ordinance (Cap 354)</i>, <i>Waste Disposal (Chemical Waste) (General) Regulation (Cap 35)</i>, as required; • Records of the quantities of wastes generated and disposed of should be maintained; • Adequate washing facilities should be provided on site; and • In accordance with good construction practice, silt traps should be used to reduce the impact to drainage caused by suspended solids arising from disturbed ground, or any construction materials such as cement and gravel. Groundwater should be disposed of in accordance with the <i>Water Pollution Control Ordinance (Cap 358)</i>. 	Work site / During the construction period	All Contractors		√		Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 35); Water Pollution Control Ordinance (Cap 358).	Complete
11.11.1		<p>Based on preliminary site investigation, the site is considered as a potentially land contaminated site as hotspots of contamination of lead and sulphur were identified. Further investigation for land contamination at this site is therefore required and is detailed in the Contamination Assessment Plan (CAP) of this section to be undertaken prior to commencement of excavation works. A Contamination Assessment Report (CAR) should be prepared and if the results of the site investigation reveal contamination at the subject site, a Remediation Action Plan (RAP) should also be prepared and submitted together with the CAR to EPD for approval.</p>	Work site / During the construction period	All Contractors		√		Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 35); Water Pollution Control Ordinance (Cap 358).	Same as above.

* All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed project.

** D=Design, C=Construction, O=Operation; N/A Not applicable

Annex E

Monitoring results

Air Quality

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
 Monthly EM&A Report

Date		Weather description	Temp (°C)	Relative Humidity (%)	Mean amount of cloud (%)	Total Rainfall (mm)	Wind direction
25-Aug-07	Sat	Mainly cloudy with a few showers.	27.7	86	86	10.3	SE
26-Aug-07	Sun	Sunny periods and isolated showers.	27.6	83	76	Trace	SE
27-Aug-07	Mon	Sunny intervals and a few showers.	27.6	89	84	25	E
28-Aug-07	Tue	Sunny periods and isolated showers.	27.9	87	80	25.9	E
29-Aug-07	Wed	Mainly fine apart from isolated showers.	28.3	85	70	1.3	E
30-Aug-07	Thu	Fine.	28.5	80	55	0.1	E to SE
31-Aug-07	Fri	Fine.	28.9	75	31	-	SE
1-Sep-07	Sat	Mainly fine.	29.1	72	60	-	SE
2-Sep-07	Sun	Sunny periods.	27.4	83	84	3.7	E
3-Sep-07	Mon	Sunny periods	28.3	79	78	Trace	E
4-Sep-07	Tue	Mainly cloudy with a few rain patches.	27.7	82	84	2.3	E
5-Sep-07	Wed	Sunny intervals and a few showers.	26.8	78	88	1.5	N
6-Sep-07	Thu	Sunny periods and a few showers.	26.7	69	87	-	N
7-Sep-07	Fri	Mainly cloudy with a few rain patches.	26.8	78	85	0.1	NE to E
8-Sep-07	Sat	Mainly cloudy with a few rain patches.	27.4	79	83	Trace	E
9-Sep-07	Sun	Cloudy with occasional rain.	27.4	81	87	Trace	E
10-Sep-07	Mon	Mainly cloudy with a few rain patches.	27.5	80	84	Trace	E
11-Sep-07	Tue	Mainly cloudy with a few rain patches.	27.8	78	59	10.7	E
12-Sep-07	Wed	Mainly cloudy with a few rain patches.	27.2	76	54	Trace	NE to E
13-Sep-07	Thu	Mainly cloudy with a few rain patches.	27.8	69	23	-	NE to E
14-Sep-07	Fri	Mainly cloudy with a few rain patches.	28.4	70	52	-	N to NE
15-Sep-07	Sat	Mainly fine and dry but hazy.	29.4	70	40	-	W to NW
16-Sep-07	Sun	Mainly fine and dry but hazy.	28.5	80	76	6	N

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
 Monthly EM&A Report


Date		Weather description	Temp (°C)	Relative Humidity (%)	Mean amount of cloud (%)	Total Rainfall (mm)	Wind direction
17-Sep-07	Mon	Hazy with isolated showers. Light winds.	28	78	82	0.5	N to NW
18-Sep-07	Tue	Mainly fine and dry but hazy.	28.9	51	35	-	N to NW
19-Sep-07	Wed	Mainly fine and dry but hazy.	28.2	54	38	-	N to NW
20-Sep-07	Thu	Sunny periods and dry with haze.	27.8	58	74	0.1	N to NE
21-Sep-07	Fri	Sunny periods.	27.9	69	81	1.7	NE
22-Sep-07	Sat	Mainly cloudy with a few rain patches.	28.7	62	73	-	NE to E
23-Sep-07	Sun	Cloudy with a few rain patches.	25.8	81	89	12.5	NE to E
24-Sep-07	Mon	Cloudy with a few rain patches.	25.4	94	90	60.1	E

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
24-hour TSP Monitoring Results at Station GCA B1

Date	Filter Weight (g)		Flow Rate (m ³ /min.)		Elapse Time		Sampling Time(hrs.)	Conc. (µg/m ³)	Weather Condition	Particulate weight(g)	Av. flow (m ³ /min)	Total vol. (m ³)
	Initial	Final	Initial	Final	Initial	Final						
25-Aug-07	3.5687	3.7066	1.31	1.31	11984.5	12008.5	24.0	73.4	Sunny	0.14	1.31	1879.2
31-Aug-07	3.5558	3.6215	1.34	1.34	12008.5	12032.5	24.0	34.0	Sunny	0.07	1.34	1931.0
06-Sep-07	3.5427	3.5717	1.34	1.34	12032.5	12056.5	24.0	15.0	Sunny	0.03	1.34	1931.0
12-Sep-07	3.5361	3.6183	1.34	1.34	12056.5	12080.5	24.0	42.6	Sunny	0.08	1.34	1931.0
18-Sep-07	3.6403	3.8835	1.34	1.34	12080.5	12104.5	24.0	125.9	Sunny	0.24	1.34	1931.0
24-Sep-07	3.3662	3.4062	1.31	1.31	12104.5	12128.5	24.0	21.3	Sunny	0.04	1.31	1879.2
								Min	15.0			
								Max	125.9			
								Average	52.0			

Remark: **Bold value indicated an Action level exceedance**
 Bold & Italic value indicated an Limit level exceedance

24-hour TSP Monitoring Results at Station GCA B1

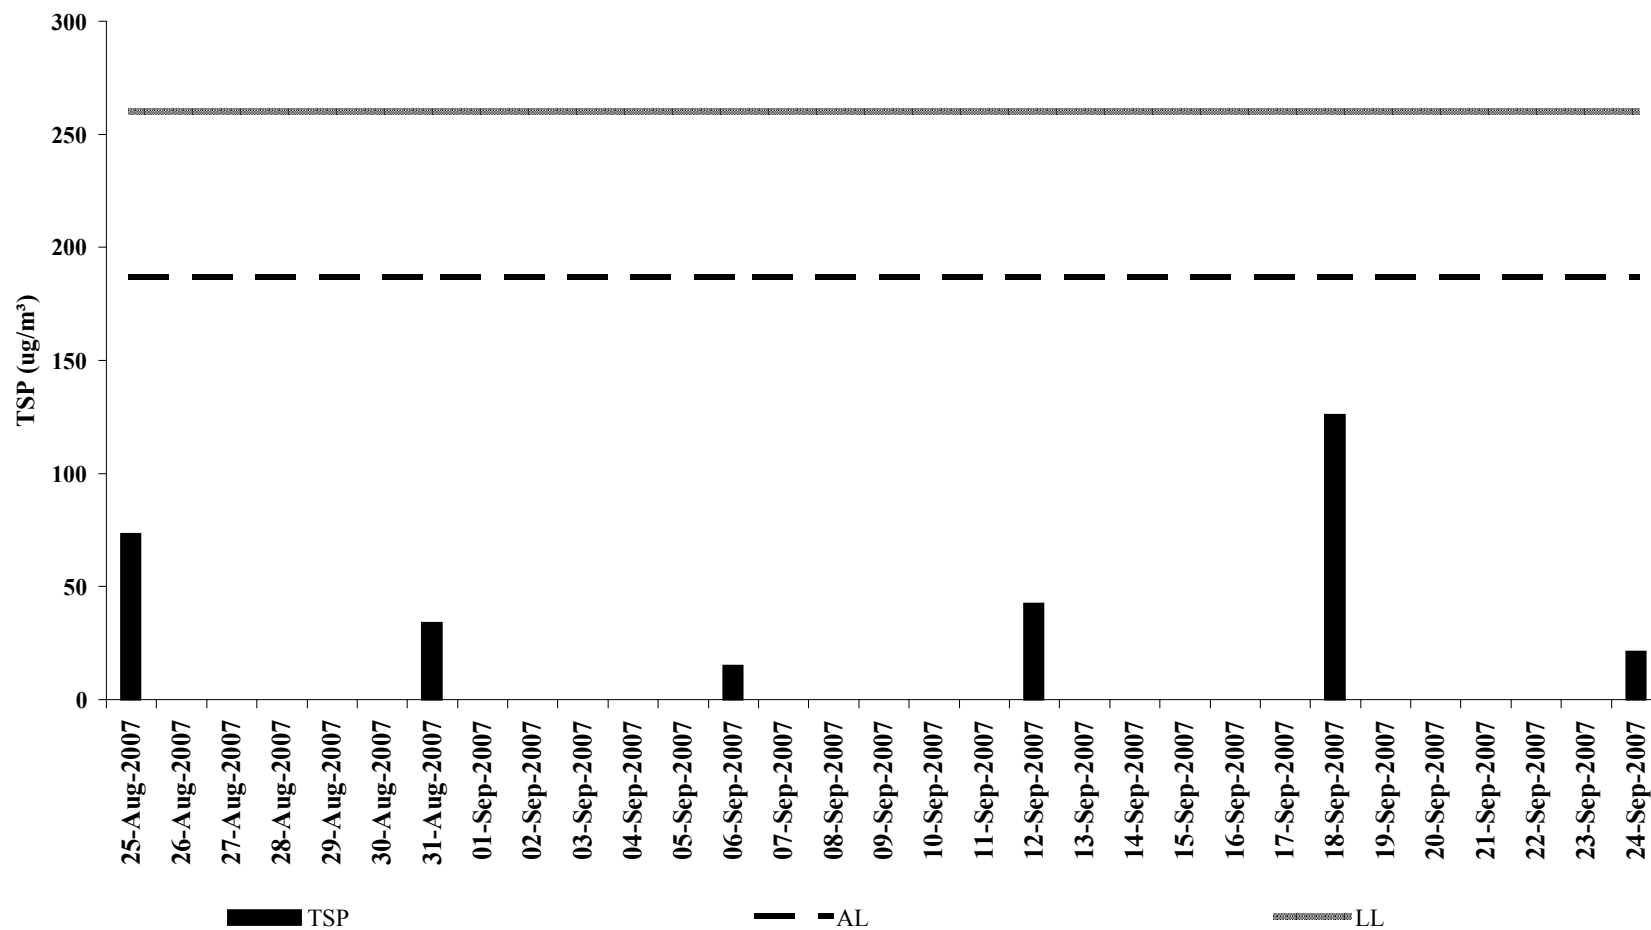

Water Quality

M_RO1		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	08:31	5.5	1.0	27.8	29.2	6.5	8.2	1.3
Mid-Ebb	03-Sep-07	09:31	5.6	1.0	26.8	28.7	6.8	8.2	1.5
Mid-Ebb	10-Sep-07	09:01	5.6	1.0	27.5	30.0	6.5	8.2	1.0
Mid-Ebb	17-Sep-07	13:31	5.6	1.0	26.7	30.0	6.7	8.3	1.7

M_RO1		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:01	5.7	1.0	26.2	31.6	6.3	8.1	1.5
Mid-Flood	03-Sep-07	12:01	5.9	1.0	27.3	31.5	6.5	8.0	1.3
Mid-Flood	10-Sep-07	15:01	5.8	1.0	27.3	31.8	6.8	8.4	1.0
Mid-Flood	17-Sep-07	08:31	5.7	1.0	27.7	31.7	6.9	8.4	1.7

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

M_RO1	Middle								
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
	27-Aug-07								
	03-Sep-07								
	10-Sep-07								
	17-Sep-07								


NOT USED


M_RO1	Middle								
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
	27-Aug-07								
	03-Sep-07								
	10-Sep-07								
	17-Sep-07								

M_RO1									
Bottom									
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	8:30	5.5	4.5	26.7	30.7	6.5	8.2	1.6
Mid-Ebb	03-Sep-07	9:30	5.6	4.6	26.3	30.2	6.3	8.3	1.7
Mid-Ebb	10-Sep-07	9:00	5.6	4.6	27.4	30.2	6.3	8.2	1.5
Mid-Ebb	17-Sep-07	13:30	5.6	4.6	27.3	29.8	6.9	8.3	1.3

M_RO1									
Bottom									
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:00	5.7	4.7	26.2	31.7	6.3	8.1	1.7
Mid-Flood	03-Sep-07	12:00	5.9	4.9	26.5	32.2	6.4	8.2	1.3
Mid-Flood	10-Sep-07	15:00	5.8	4.8	27.3	31.9	6.8	8.4	1.4
Mid-Flood	17-Sep-07	8:30	5.7	4.7	27.7	31.8	6.9	8.4	1.1

M_RO1	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	3.0	-	4.0	4.0	-	8.0	4.8
03-Sep-07	4.0	-	2.0	6.0	-	5.0	4.3
10-Sep-07	6.0	-	6.0	7.0	-	6.0	6.3
17-Sep-07	2.0	-	4.0	3.0	-	5.0	3.5

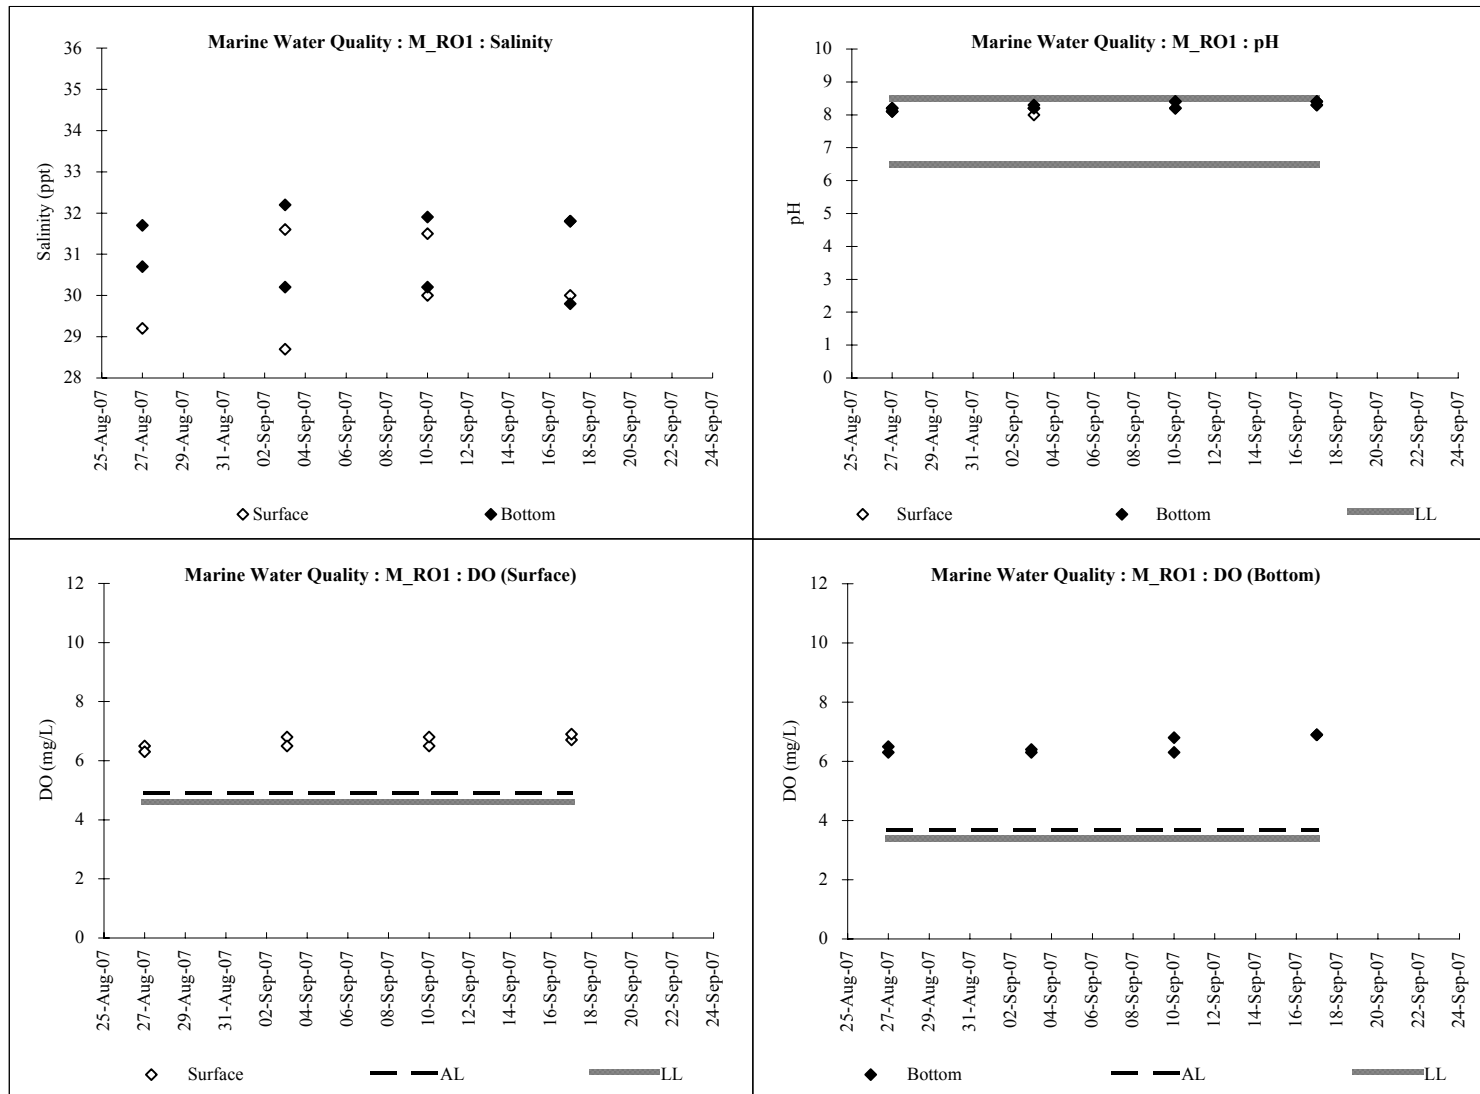

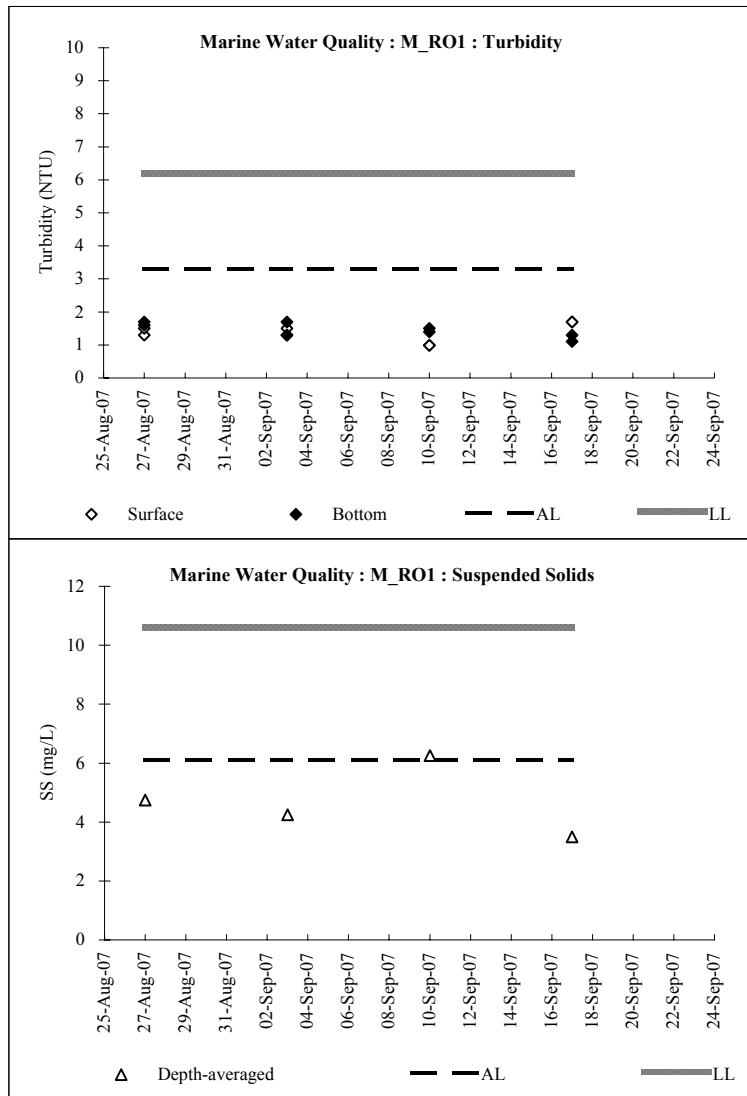

KLW		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	08:42	13.4	1.0	28.1	29.7	6.4	8.2	1.5
Mid-Ebb	03-Sep-07	09:42	13.3	1.0	27.3	30.0	6.3	8.2	1.3
Mid-Ebb	10-Sep-07	09:12	13.5	1.0	27.6	29.7	6.5	8.2	1.4
Mid-Ebb	17-Sep-07	13:42	13.6	1.0	26.9	29.7	6.9	8.2	2.3

KLW		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:12	13.9	1.0	26.1	31.7	6.2	8.1	1.3
Mid-Flood	03-Sep-07	12:12	14.0	1.0	28.1	32.3	6.4	8.1	1.5
Mid-Flood	10-Sep-07	15:12	13.8	1.0	27.3	31.9	6.3	8.4	1.2
Mid-Flood	17-Sep-07	08:11	13.8	1.0	27.6	31.8	6.8	8.3	2.8

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


KLW		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	08:41	13.4	6.7	26.7	29.6	6.3	8.2	1.4
Mid-Ebb	03-Sep-07	09:41	13.3	6.7	26.3	30.1	6.4	8.3	1.6
Mid-Ebb	10-Sep-07	09:11	13.5	6.8	27.3	30.1	6.4	8.1	1.6
Mid-Ebb	17-Sep-07	13:41	13.6	6.8	27.0	30.0	6.4	8.2	1.3


KLW		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:11	13.9	7.0	26.2	31.9	6.2	8.1	1.1
Mid-Flood	03-Sep-07	12:11	14.0	7.0	26.7	32.5	6.4	8.2	1.7
Mid-Flood	10-Sep-07	15:11	13.8	6.9	27.3	32.1	6.8	8.4	1.2
Mid-Flood	17-Sep-07	08:41	13.8	6.9	27.4	32.0	6.6	8.4	1.5

KLW		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	8:40	13.4	12.4	26.6	30.1	6.2	8.3	1.7
Mid-Ebb	03-Sep-07	9:40	13.3	12.3	25.8	30.6	6.3	8.3	1.6
Mid-Ebb	10-Sep-07	9:10	13.5	12.5	26.9	29.7	6.3	8.2	2.5
Mid-Ebb	17-Sep-07	13:40	13.6	12.6	27.0	30.2	6.4	8.2	2.9

KLW		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:10	13.9	12.9	26.4	32.3	6.1	8.1	1.4
Mid-Flood	03-Sep-07	12:10	14.0	13.0	25.9	33.1	6.4	8.2	2.2
Mid-Flood	10-Sep-07	15:10	13.8	12.8	26.9	32.1	6.2	8.4	2.7
Mid-Flood	17-Sep-07	8:40	13.8	12.8	27.1	32.1	6.2	8.4	3.7

KLW	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	4.0	6.0	5.0	3.0	2.0	7.0	4.5
03-Sep-07	2.0	2.0	2.0	4.0	4.0	3.0	2.8
10-Sep-07	4.0	6.0	6.0	6.0	5.0	5.0	5.3
17-Sep-07	3.0	3.0	5.0	5.0	3.0	5.0	4.0

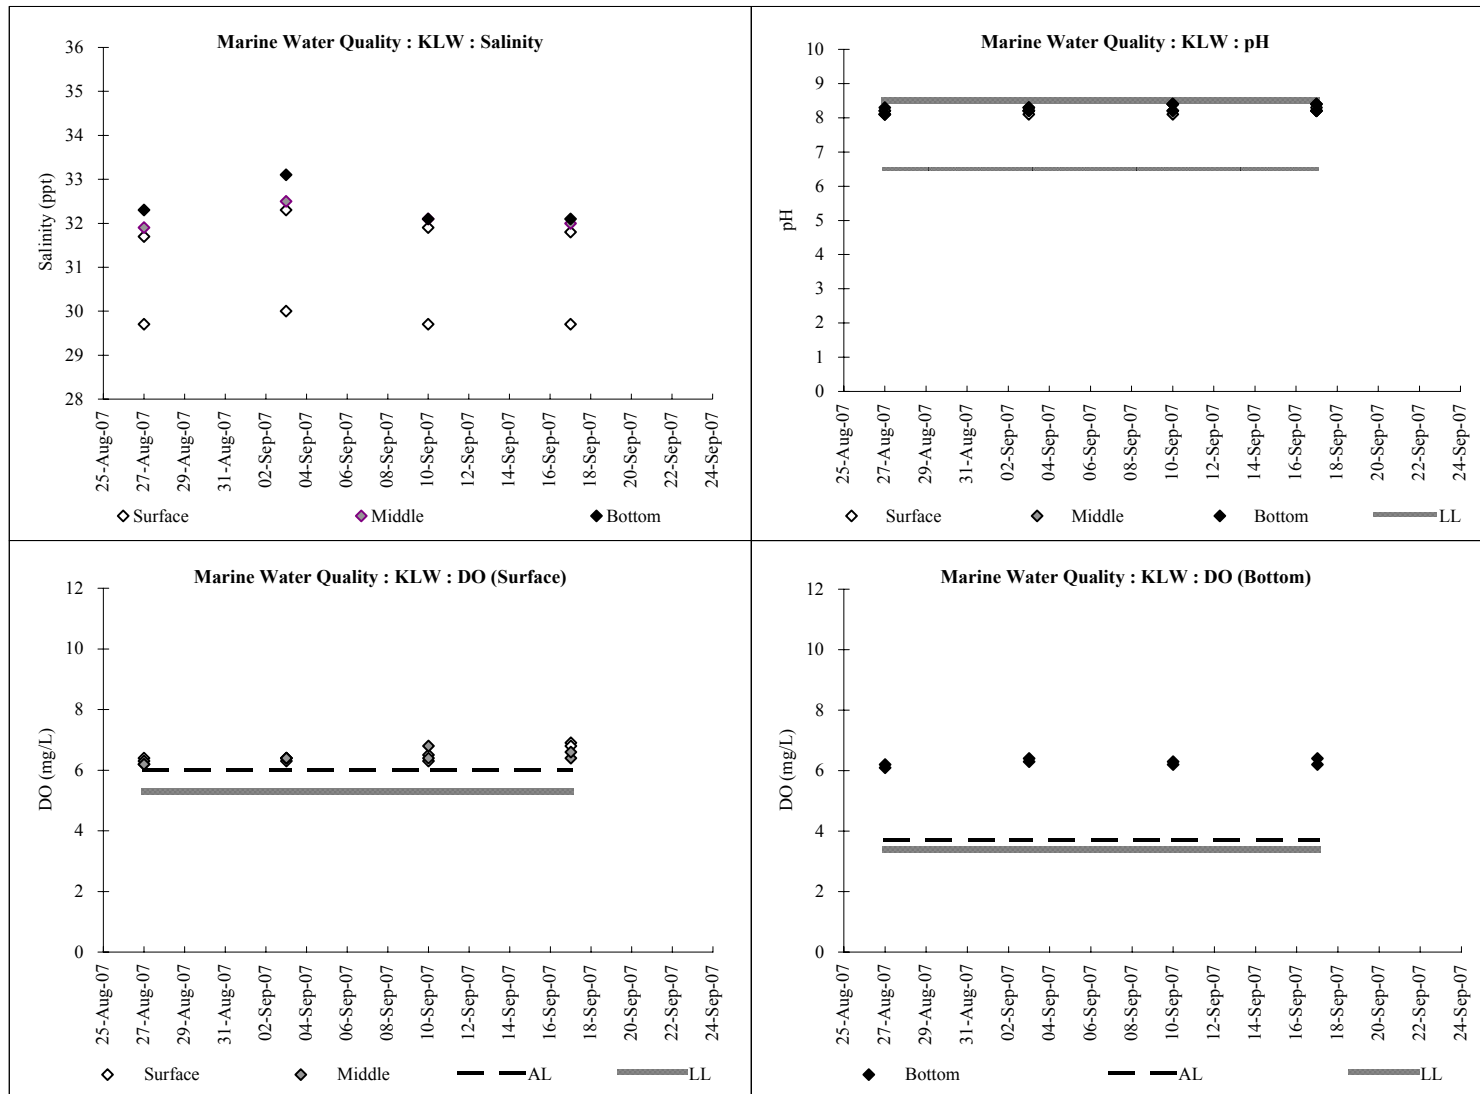

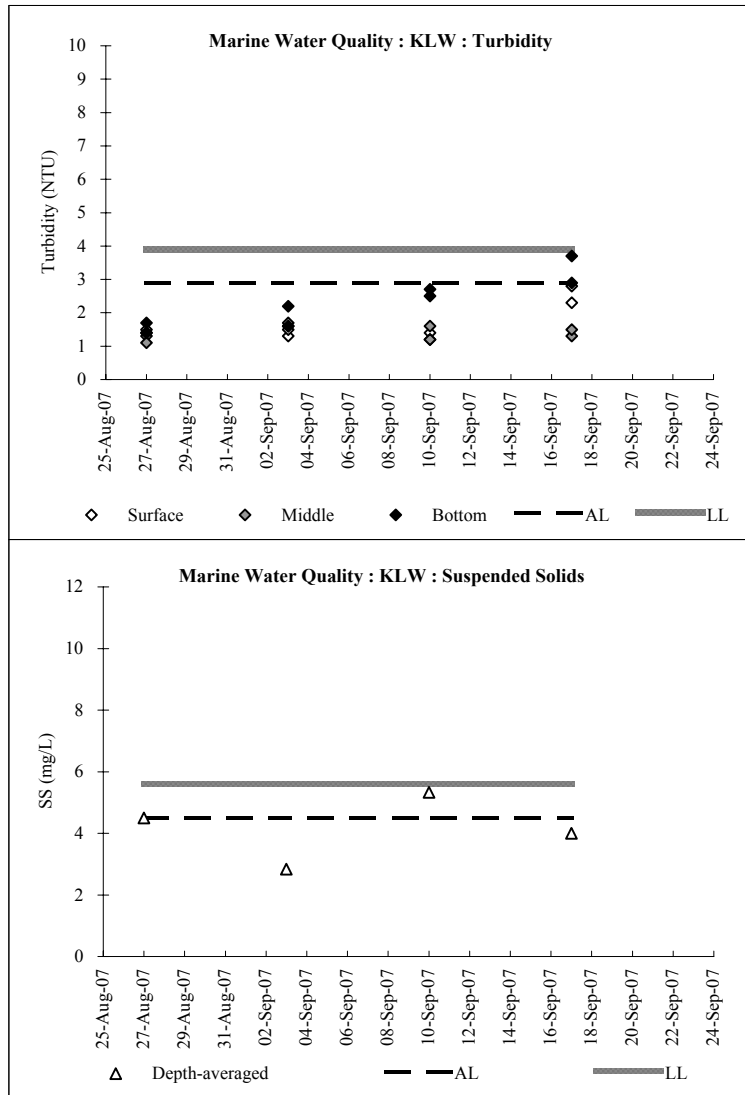

M_A		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	09:02	7.9	1.0	27.2	27.4	6.2	8.3	2.2
Mid-Ebb	03-Sep-07	10:02	7.8	1.0	27.1	27.9	6.3	8.3	2.1
Mid-Ebb	10-Sep-07	09:32	7.7	1.0	27.4	29.6	6.3	8.1	2.3
Mid-Ebb	17-Sep-07	14:02	7.8	1.0	26.9	30.7	6.8	8.2	1.5

M_A		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:32	8.2	1.0	25.9	30.9	6.0	8.1	2.7
Mid-Flood	03-Sep-07	12:32	8.1	1.0	28.3	30.3	6.4	8.1	2.9
Mid-Flood	10-Sep-07	15:32	7.9	1.0	27.2	32.1	6.3	8.2	3.0
Mid-Flood	17-Sep-07	09:02	8.1	1.0	27.6	31.8	6.9	8.4	1.8

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_A		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	09:01	7.9	4.0	26.5	29.1	6.1	8.2	2.6
Mid-Ebb	03-Sep-07	10:01	7.8	3.9	26.4	29.6	6.3	8.2	2.8
Mid-Ebb	10-Sep-07	09:31	7.7	3.9	27.3	30.5	6.2	8.2	1.9
Mid-Ebb	17-Sep-07	14:01	7.8	3.9	27.3	29.5	6.7	8.2	1.3


M_A		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:31	8.2	4.1	25.9	31.7	6.0	8.1	2.8
Mid-Flood	03-Sep-07	12:31	8.1	4.1	26.7	32.1	6.1	8.1	3.0
Mid-Flood	10-Sep-07	15:31	7.9	4.0	27.3	32.2	6.4	8.3	1.5
Mid-Flood	17-Sep-07	09:01	8.1	4.1	27.7	31.9	6.9	8.4	1.6

M_A		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	9:00	7.9	6.9	26.3	29.0	6.2	8.2	2.0
Mid-Ebb	03-Sep-07	10:00	7.8	6.8	26.1	30.0	6.3	8.3	2.2
Mid-Ebb	10-Sep-07	9:30	7.7	6.7	27.3	30.1	6.2	8.1	2.5
Mid-Ebb	17-Sep-07	14:00	7.8	6.8	27.2	30.1	6.2	8.2	2.3

M_A		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:30	8.2	7.2	25.9	31.1	6.1	8.1	2.4
Mid-Flood	03-Sep-07	12:30	8.1	7.1	26.3	33.2	6.2	8.1	2.9
Mid-Flood	10-Sep-07	15:30	7.9	6.9	27.2	32.3	6.1	8.3	3.0
Mid-Flood	17-Sep-07	9:00	8.1	7.1	27.4	32.0	6.1	8.4	2.7

M_A	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	2.0	4.0	3.0	3.0	2.0	2.0	2.7
03-Sep-07	2.0	2.0	4.0	4.0	5.0	5.0	3.7
10-Sep-07	4.0	3.0	6.0	3.0	3.0	4.0	3.8
17-Sep-07	3.0	2.0	2.0	2.0	3.0	4.0	2.7

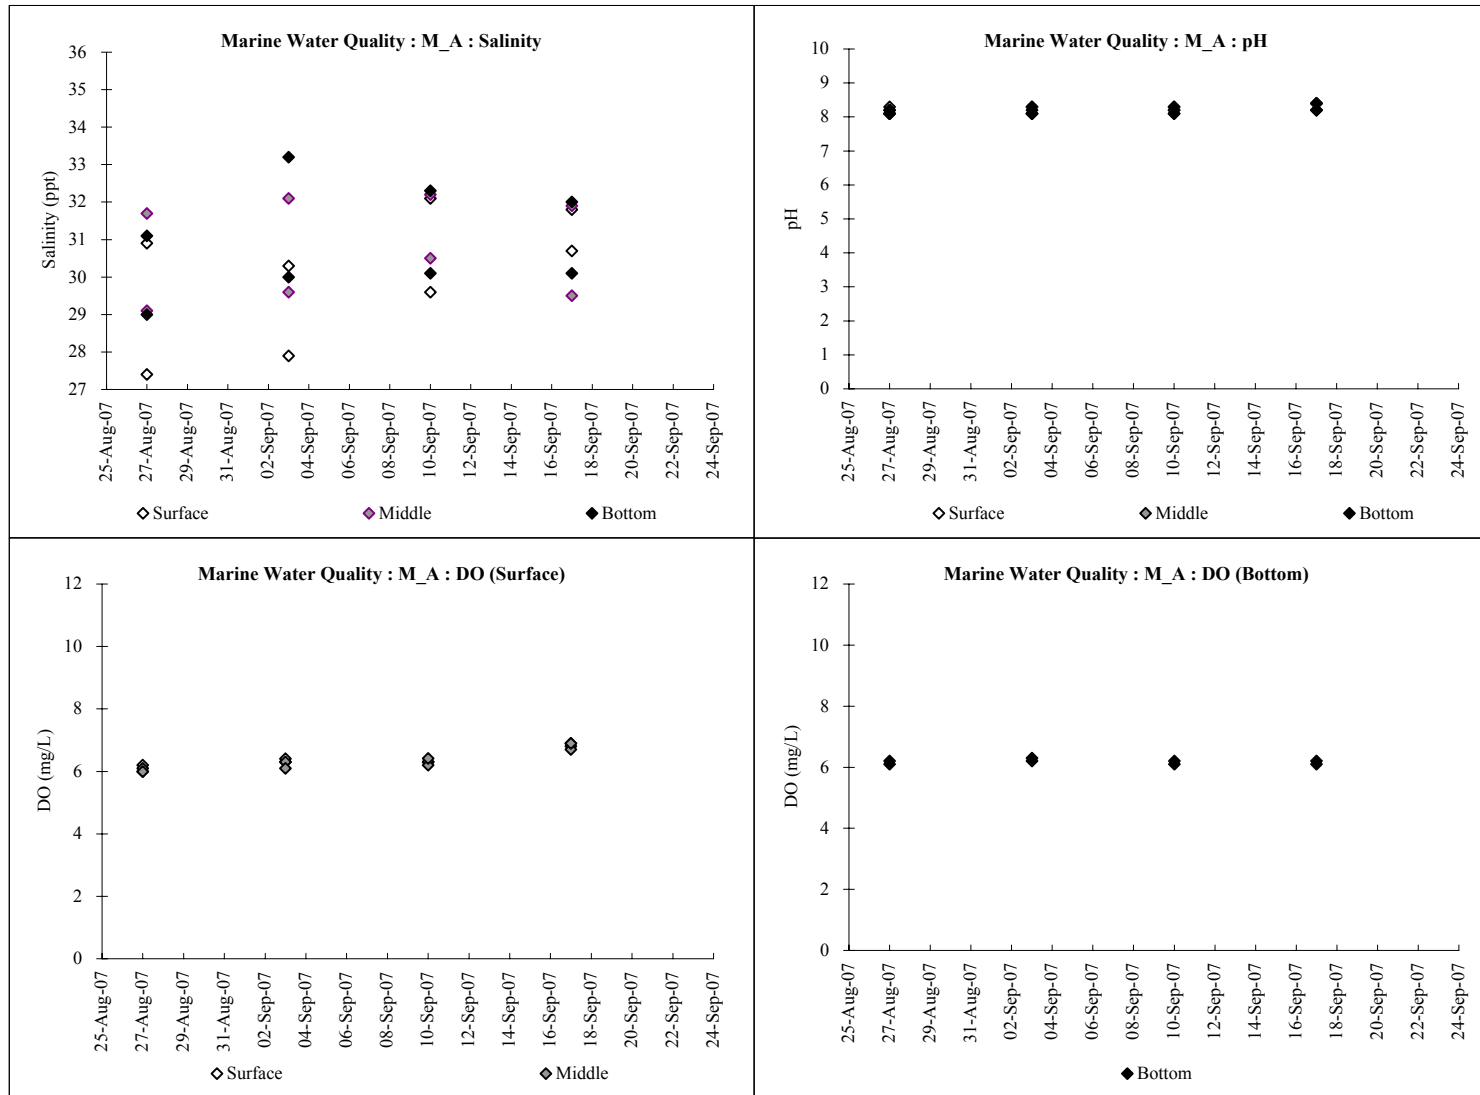

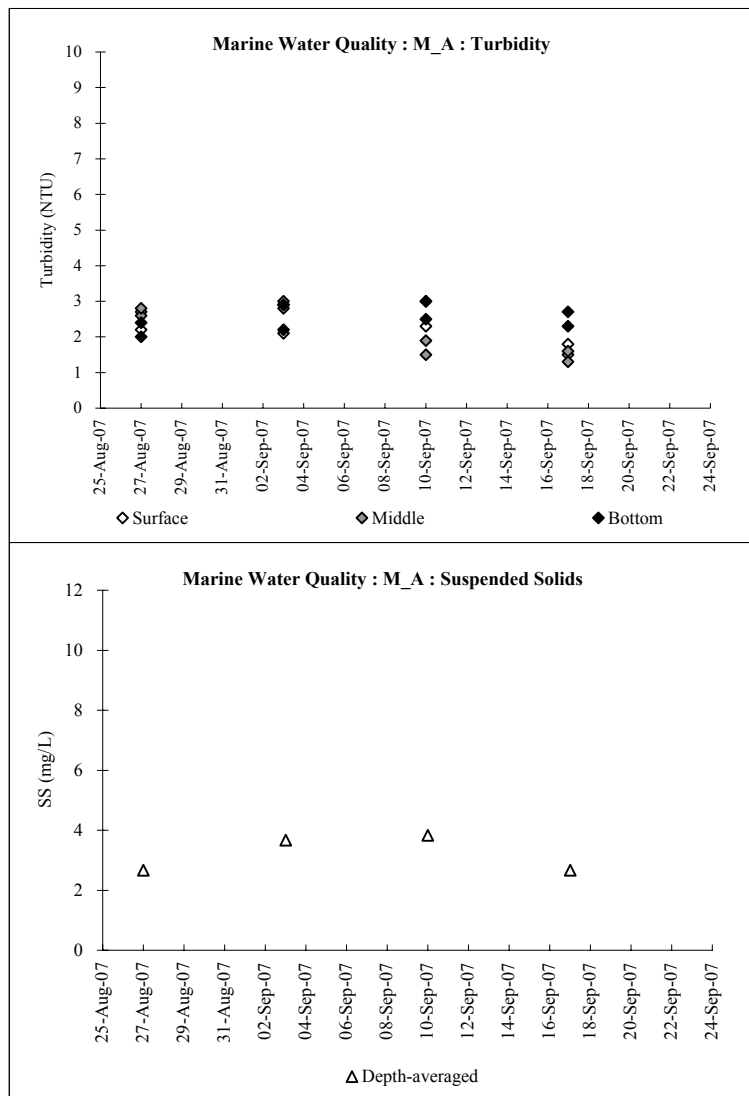

M_Marsh		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	09:17	7.9	1.0	27.8	29.6	6.5	8.2	3.7
Mid-Ebb	03-Sep-07	10:17	7.8	1.0	27.6	29.3	6.3	8.3	2.7
Mid-Ebb	10-Sep-07	09:47	7.8	1.0	27.4	29.7	6.2	8.1	2.9
Mid-Ebb	17-Sep-07	14:17	7.7	1.0	27.0	28.9	6.9	8.2	3.9

M_Marsh		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:47	8.3	1.0	26.0	31.7	6.6	8.1	4.6
Mid-Flood	03-Sep-07	12:47	8.2	1.0	28.2	32.8	6.4	8.1	3.7
Mid-Flood	10-Sep-07	15:47	8.0	1.0	27.2	32.3	6.1	8.3	3.3
Mid-Flood	17-Sep-07	09:17	8.2	1.0	27.9	31.9	6.8	8.4	4.7

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_Marsh									
Middle									
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	09:16	7.9	4.0	27.3	29.7	6.5	8.2	2.8
Mid-Ebb	03-Sep-07	10:16	7.8	3.9	26.8	30.1	6.3	8.2	2.6
Mid-Ebb	10-Sep-07	09:46	7.8	3.9	27.4	30.0	6.3	8.2	1.6
Mid-Ebb	17-Sep-07	14:16	7.7	3.9	27.1	30.2	6.6	8.2	3.9


M_Marsh									
Middle									
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:46	8.3	4.2	26.0	31.9	6.6	8.1	3.2
Mid-Flood	03-Sep-07	12:46	8.2	4.1	27.1	33.1	6.4	8.1	3.6
Mid-Flood	10-Sep-07	15:46	8.0	4.0	27.3	32.4	6.2	8.3	1.7
Mid-Flood	17-Sep-07	09:16	8.2	4.1	27.8	32.0	6.8	8.4	4.3

M_Marsh		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	9:15	7.9	6.9	26.2	30.1	6.4	8.2	2.2
Mid-Ebb	03-Sep-07	10:15	7.8	6.8	26.0	30.3	6.3	8.3	2.6
Mid-Ebb	10-Sep-07	9:45	7.8	6.8	27.4	30.3	5.7	8.2	2.9
Mid-Ebb	17-Sep-07	14:15	7.7	6.7	27.1	30.3	5.9	8.2	5.3

M_Marsh		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:45	8.3	7.3	25.9	32.0	6.6	8.1	2.4
Mid-Flood	03-Sep-07	12:45	8.2	7.2	26.5	33.4	6.4	8.2	2.5
Mid-Flood	10-Sep-07	15:45	8.0	7.0	27.3	32.5	5.9	8.3	3.3
Mid-Flood	17-Sep-07	9:15	8.2	7.2	27.5	32.1	6.0	8.3	4.1

M_Marsh	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	9.0	5.0	4.0	3.0	4.0	6.0	5.2
03-Sep-07	3.0	3.0	2.0	4.0	4.0	4.0	3.3
10-Sep-07	2.0	2.0	4.0	8.0	4.0	6.0	4.3
17-Sep-07	2.0	2.0	2.0	3.0	4.0	6.0	3.2

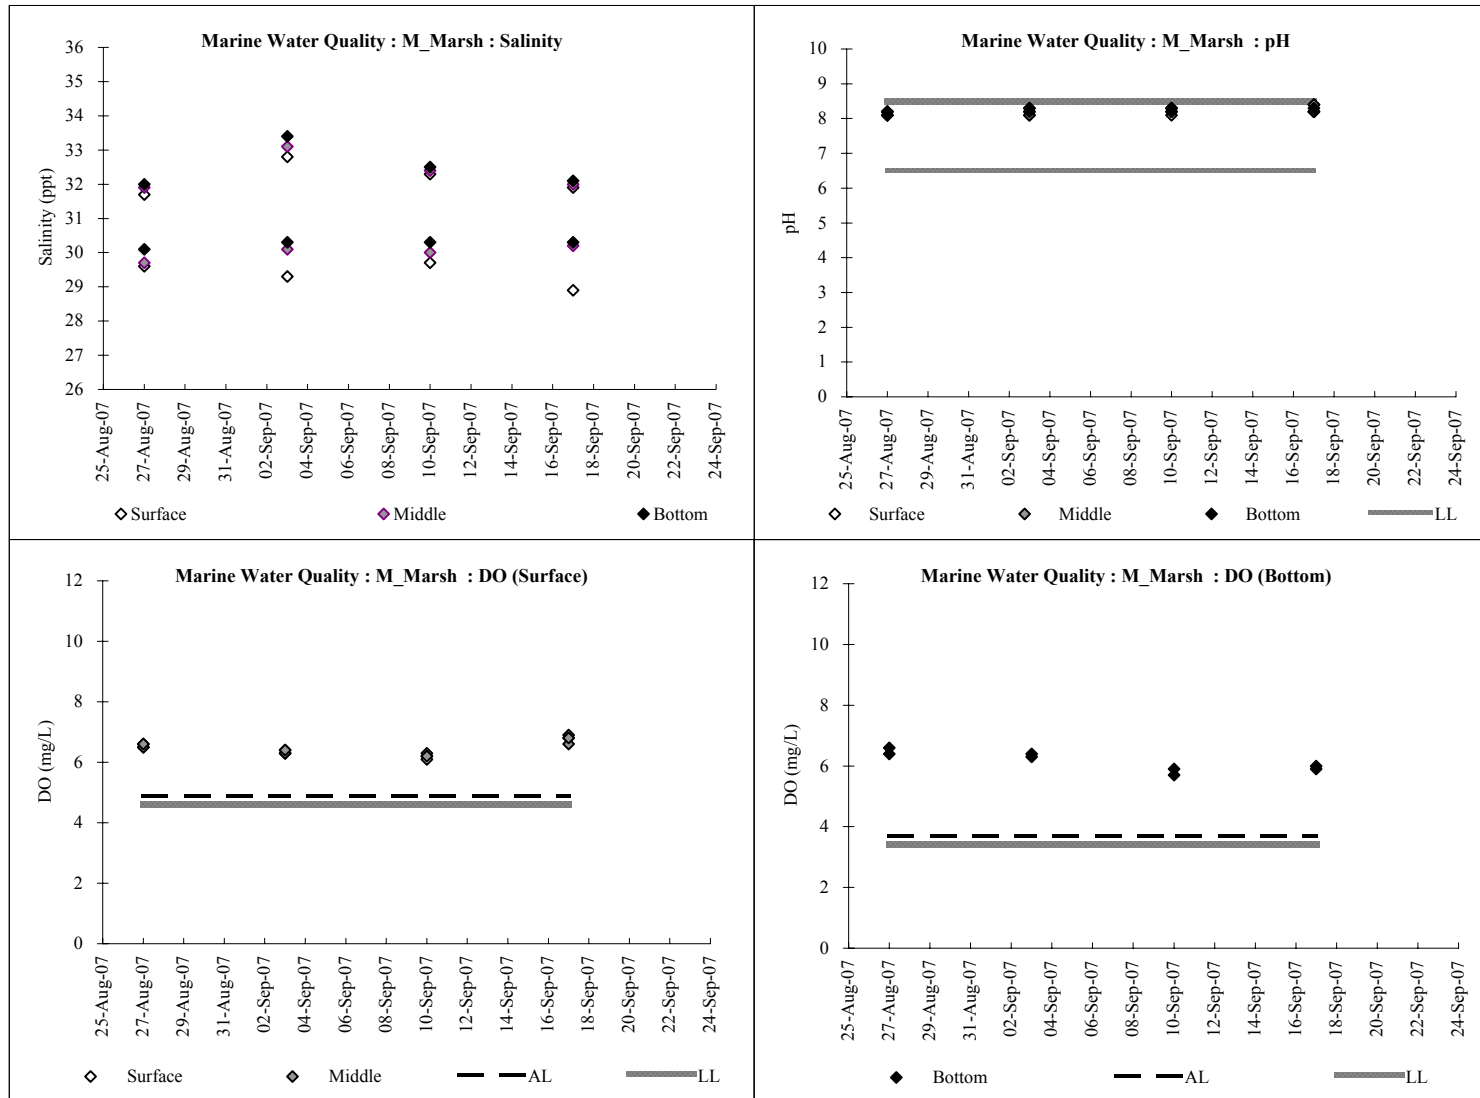

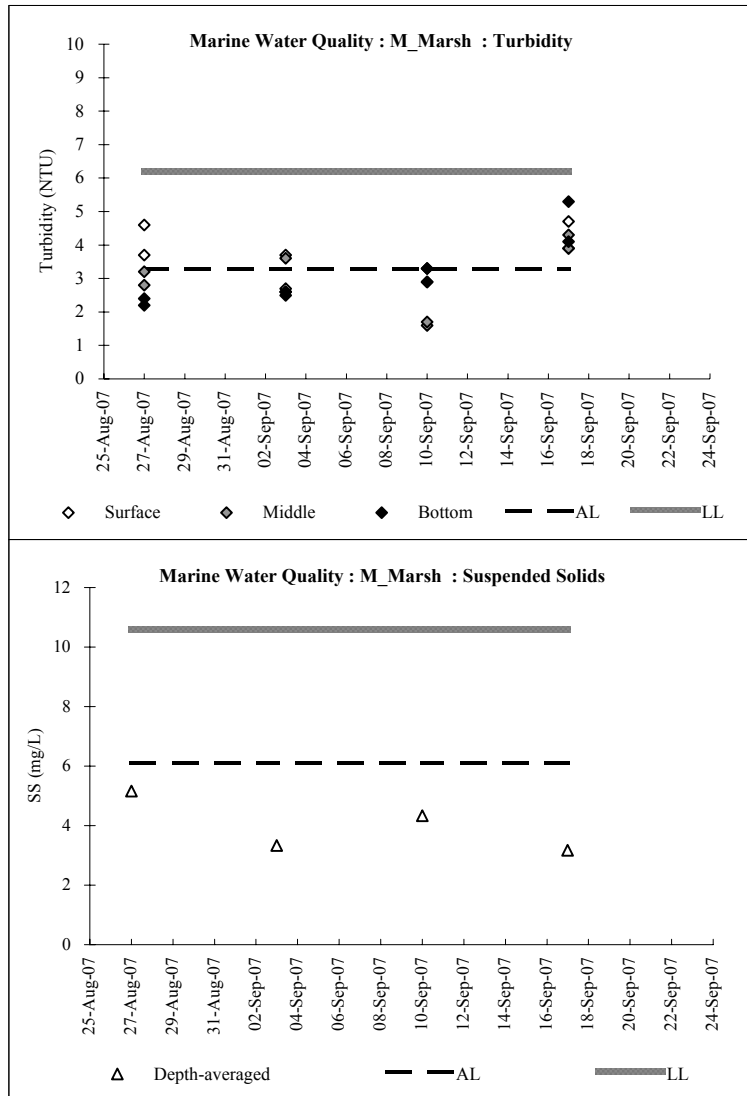

TTC		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	13:07	9.7	1.0	27.8	28.6	6.3	8.3	2.7
Mid-Ebb	03-Sep-07	10:37	9.8	1.0	26.8	28.5	6.4	8.3	2.9
Mid-Ebb	10-Sep-07	10:07	9.6	1.0	27.5	29.9	6.2	8.1	1.6
Mid-Ebb	17-Sep-07	14:37	9.7	1.0	26.9	28.7	6.6	8.2	1.9

TTC		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:57	10.2	1.0	26.1	31.9	6.2	8.2	3.0
Mid-Flood	03-Sep-07	12:57	10.0	1.0	27.8	32.5	6.3	8.2	3.1
Mid-Flood	10-Sep-07	15:57	9.8	1.0	27.2	32.1	6.3	8.2	2.1
Mid-Flood	17-Sep-07	09:27	9.9	1.0	27.8	31.9	7.0	8.3	1.6

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


TTC		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	13:06	9.7	4.9	27.3	29.4	6.2	8.3	2.0
Mid-Ebb	03-Sep-07	10:36	9.8	4.9	26.8	30.2	6.1	8.3	2.2
Mid-Ebb	10-Sep-07	10:06	9.6	4.8	27.3	30.0	6.4	8.2	2.6
Mid-Ebb	17-Sep-07	14:36	9.7	4.9	26.9	30.2	6.6	8.2	1.6


TTC		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:56	10.2	5.1	26.1	32.0	6.1	8.2	2.2
Mid-Flood	03-Sep-07	12:56	10.0	5.0	27.4	32.6	6.2	8.2	2.6
Mid-Flood	10-Sep-07	15:56	9.8	4.9	27.3	32.3	6.3	8.4	2.9
Mid-Flood	17-Sep-07	09:26	9.9	5.0	27.6	32.1	6.7	8.3	1.8

TTC		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	13:05	9.7	8.7	26.7	29.6	6.0	8.3	3.4
Mid-Ebb	03-Sep-07	10:35	9.8	8.8	26.4	30.3	6.1	8.3	2.9
Mid-Ebb	10-Sep-07	10:05	9.6	8.6	27.2	30.1	6.3	8.2	2.0
Mid-Ebb	17-Sep-07	14:35	9.7	8.7	27.1	30.3	6.1	8.2	2.0

TTC		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	15:55	10.2	9.2	26.1	32.1	5.8	8.2	4.4
Mid-Flood	03-Sep-07	12:55	10.0	9.0	26.5	32.6	6.2	8.2	3.1
Mid-Flood	10-Sep-07	15:55	9.8	8.8	27.2	32.3	6.2	8.4	2.3
Mid-Flood	17-Sep-07	9:25	9.9	8.9	27.3	32.3	6.4	8.4	2.2

TTC	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	2.0	4.0	3.0	4.0	2.0	2.0	2.8
03-Sep-07	2.0	2.0	2.0	3.0	2.0	6.0	2.8
10-Sep-07	8.0	4.0	4.0	6.0	4.0	6.0	5.3
17-Sep-07	2.0	2.0	3.0	4.0	4.0	2.0	2.8

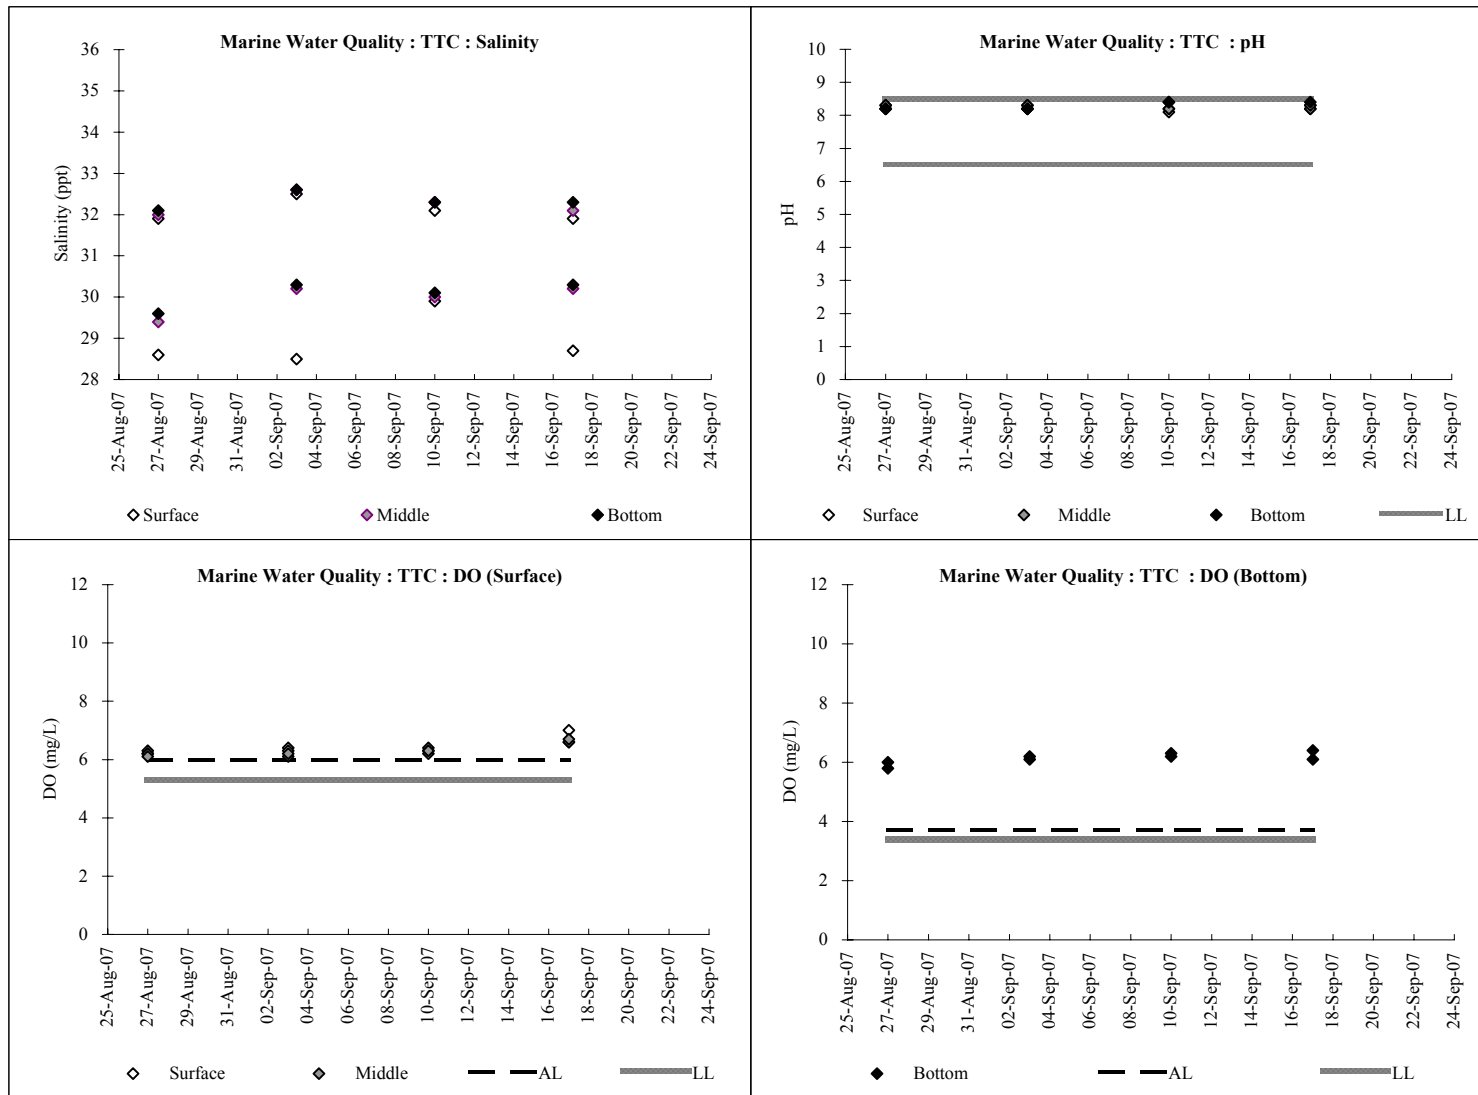

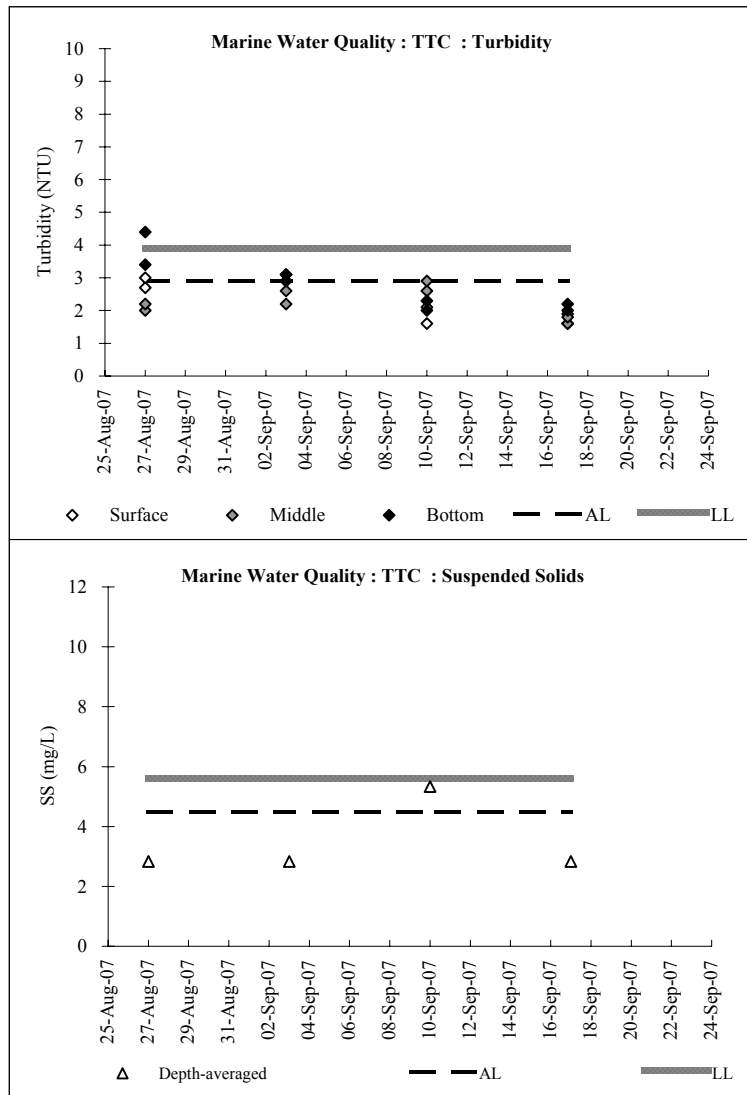

M_BP		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	13:17	8.0	1.0	28.1	30.3	6.2	8.3	2.2
Mid-Ebb	03-Sep-07	10:47	8.3	1.0	26.9	29.8	6.3	8.3	2.7
Mid-Ebb	10-Sep-07	10:17	8.6	1.0	27.6	29.4	6.4	8.2	1.6
Mid-Ebb	17-Sep-07	14:47	8.7	1.0	26.8	29.3	6.9	8.2	2.0

M_BP		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:07	8.9	1.0	26.1	32.3	6.1	8.2	1.9
Mid-Flood	03-Sep-07	13:07	8.7	1.0	27.9	33.2	6.3	8.1	2.4
Mid-Flood	10-Sep-07	16:07	8.7	1.0	27.3	32.1	6.5	8.3	1.5
Mid-Flood	17-Sep-07	09:37	8.9	1.0	27.6	32.0	7.3	8.4	1.7

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_BP		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	13:16	8.0	4.0	27.3	30.1	6.3	8.3	2.5
Mid-Ebb	03-Sep-07	10:46	8.3	4.2	26.3	30.5	6.2	8.3	2.2
Mid-Ebb	10-Sep-07	10:16	8.6	4.3	27.4	30.0	6.4	8.2	1.9
Mid-Ebb	17-Sep-07	14:46	8.7	4.4	27.1	30.3	7.0	8.2	1.8


M_BP		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:06	8.9	4.5	26.0	32.4	6.1	8.2	2.1
Mid-Flood	03-Sep-07	13:06	8.7	4.4	27.2	33.1	6.2	8.2	2.5
Mid-Flood	10-Sep-07	16:06	8.7	4.4	27.4	32.3	6.5	8.4	1.8
Mid-Flood	17-Sep-07	09:36	8.9	4.5	27.6	32.2	7.4	8.4	1.5

M_BP		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	13:15	8.0	7.0	26.8	30.2	6.2	8.3	2.2
Mid-Ebb	03-Sep-07	10:45	8.3	7.3	26.3	30.6	6.1	8.3	2.4
Mid-Ebb	10-Sep-07	10:15	8.6	7.6	27.3	30.2	6.4	8.2	3.8
Mid-Ebb	17-Sep-07	14:45	8.7	7.7	27.2	30.6	6.9	8.2	2.0

M_BP		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:05	8.9	7.9	26.1	32.4	6.1	8.2	2.4
Mid-Flood	03-Sep-07	13:05	8.7	7.7	26.8	33.2	6.2	8.2	2.6
Mid-Flood	10-Sep-07	16:05	8.7	7.7	27.3	32.4	6.3	8.4	4.7
Mid-Flood	17-Sep-07	9:35	8.9	7.9	27.5	32.2	7.2	8.4	2.2

M_BP	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	4.0	5.0	5.0	2.0	3.0	5.0	4.0
03-Sep-07	2.0	3.0	4.0	2.0	3.0	3.0	2.8
10-Sep-07	7.0	9.0	6.0	5.0	7.0	4.0	6.3
17-Sep-07	2.0	2.0	2.0	2.0	4.0	4.0	2.7

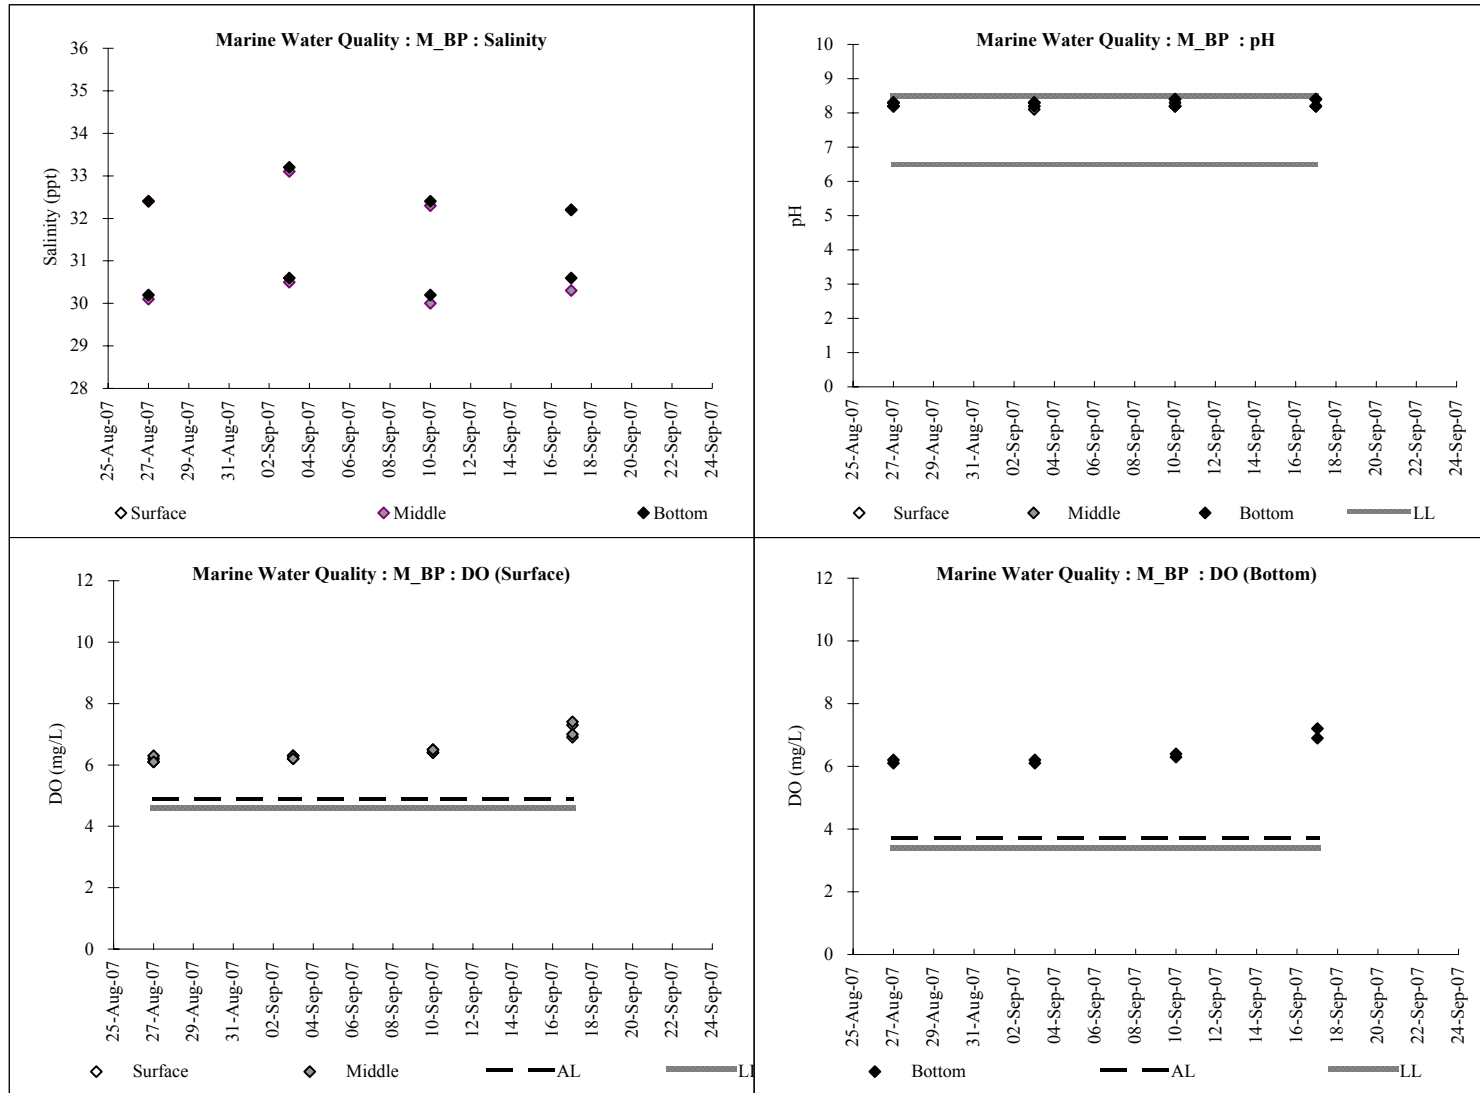

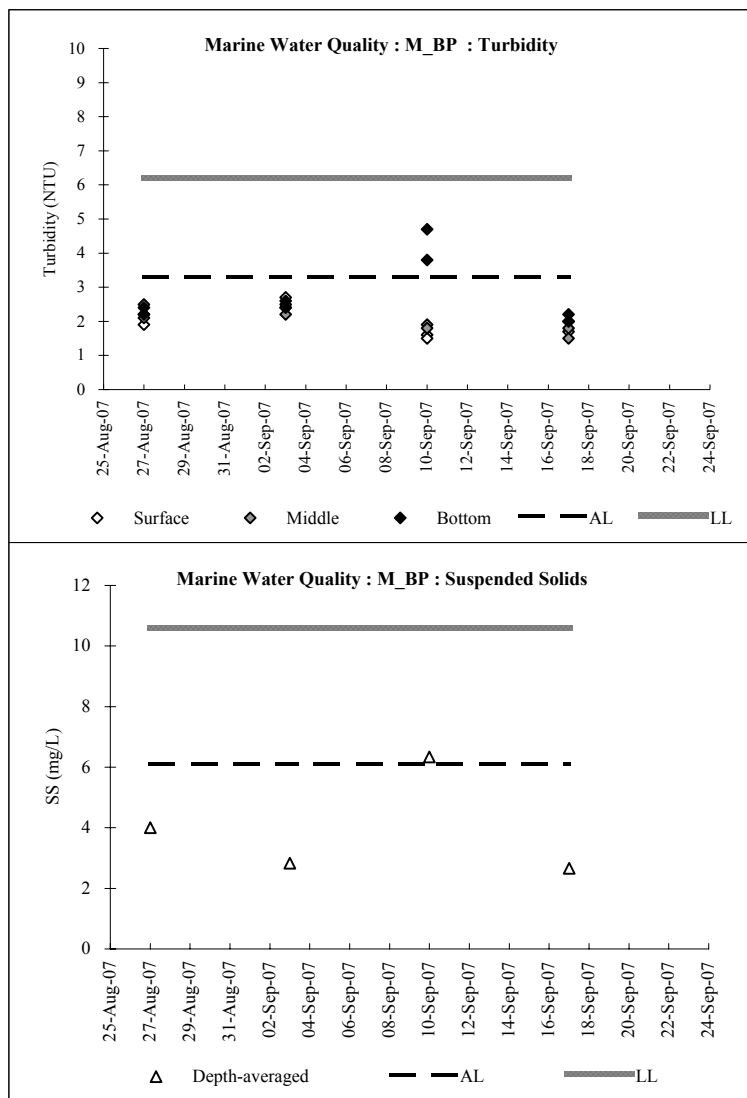

M Coral		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:22	9.7	1.0	27.9	30.2	6.3	8.3	2.5
Mid-Ebb	03-Sep-07	11:52	9.6	1.0	26.6	30.0	6.2	8.3	2.6
Mid-Ebb	10-Sep-07	11:22	9.3	1.0	27.4	30.0	6.3	8.2	1.6
Mid-Ebb	17-Sep-07	15:52	9.7	1.0	27.0	30.3	6.9	8.2	1.6

M Coral		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:17	10.6	1.0	26.2	32.7	6.4	8.2	2.1
Mid-Flood	03-Sep-07	13:17	10.7	1.0	27.3	33.2	6.2	8.1	2.6
Mid-Flood	10-Sep-07	16:17	10.4	1.0	27.3	32.2	6.6	8.3	1.2
Mid-Flood	17-Sep-07	09:47	10.0	1.0	27.6	32.1	7.1	8.4	2.0

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M Coral		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:21	9.7	4.9	27.3	30.5	6.2	8.3	1.5
Mid-Ebb	03-Sep-07	11:51	9.6	4.8	26.2	30.2	6.4	8.3	2.0
Mid-Ebb	10-Sep-07	11:21	9.3	4.7	27.2	30.1	6.2	8.1	1.6
Mid-Ebb	17-Sep-07	15:51	9.7	4.9	27.3	30.1	7.0	8.2	1.0


M Coral		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:16	10.6	5.3	26.2	32.9	6.3	8.2	2.0
Mid-Flood	03-Sep-07	13:16	10.7	5.4	27.3	32.9	6.3	8.2	2.5
Mid-Flood	10-Sep-07	16:16	10.4	5.2	27.3	32.3	6.3	8.1	1.5
Mid-Flood	17-Sep-07	09:46	10.0	5.0	27.7	32.2	7.2	8.4	1.0

M Coral		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:20	9.7	8.7	27.0	30.4	6.2	8.3	1.6
Mid-Ebb	03-Sep-07	11:50	9.6	8.6	26.0	30.9	6.3	8.3	2.1
Mid-Ebb	10-Sep-07	11:20	9.3	8.3	27.2	30.6	6.2	8.1	1.8
Mid-Ebb	17-Sep-07	15:50	9.7	8.7	27.2	30.3	6.8	8.2	1.0

M Coral		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:15	10.6	9.6	26.3	32.8	6.3	8.2	2.1
Mid-Flood	03-Sep-07	13:15	10.7	9.7	26.3	33.6	6.2	8.2	2.6
Mid-Flood	10-Sep-07	16:15	10.4	9.4	27.2	32.6	6.3	8.2	1.9
Mid-Flood	17-Sep-07	9:45	10.0	9.0	27.5	32.6	6.9	8.4	1.6

M_Coral	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	5.0	6.0	4.0	7.0	4.0	7.0	5.5
03-Sep-07	3.0	4.0	3.0	3.0	2.0	3.0	3.0
10-Sep-07	2.0	3.0	2.0	6.0	6.0	6.0	4.2
17-Sep-07	2.0	3.0	2.0	5.0	6.0	4.0	3.7

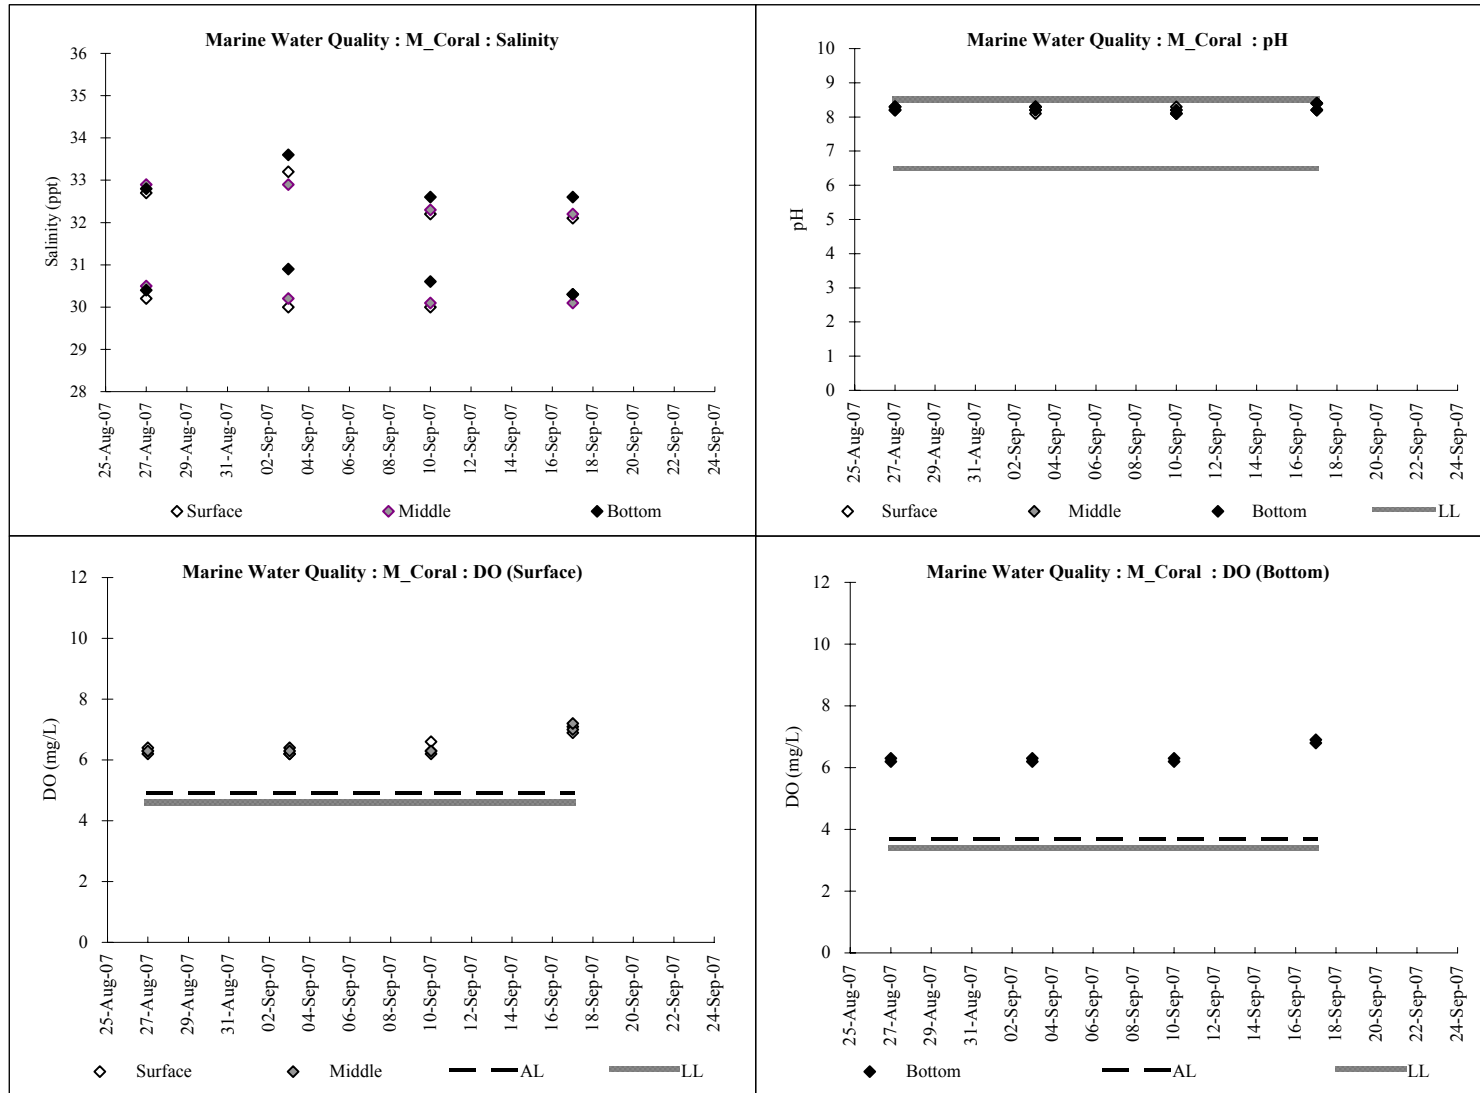

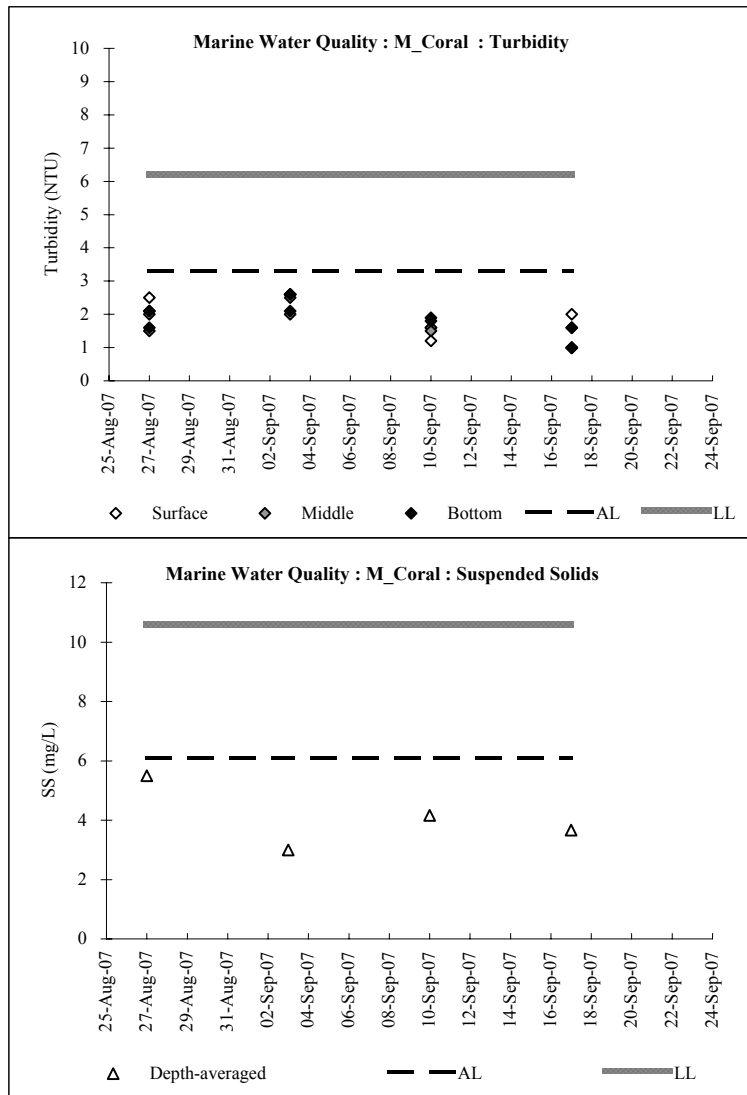

M_B		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:32	16.9	1.0	28.6	29.5	6.5	8.2	1.7
Mid-Ebb	03-Sep-07	12:02	17.0	1.0	27.3	30.1	6.4	8.2	2.0
Mid-Ebb	10-Sep-07	11:32	16.7	1.0	27.4	31.0	6.4	8.1	1.0
Mid-Ebb	17-Sep-07	16:02	16.7	1.0	26.7	29.9	6.9	8.2	1.9

M_B		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:27	17.5	1.0	27.1	31.2	6.3	8.1	1.9
Mid-Flood	03-Sep-07	13:27	17.3	1.0	28.3	33.6	6.5	8.1	2.3
Mid-Flood	10-Sep-07	16:27	17.0	1.0	27.3	33.2	6.3	8.2	1.1
Mid-Flood	17-Sep-07	09:57	17.2	1.0	27.3	32.0	6.8	8.4	1.8

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_B		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:31	16.9	8.5	27.5	30.2	6.3	8.2	2.0
Mid-Ebb	03-Sep-07	12:01	17.0	8.5	27.0	30.3	6.5	8.2	2.0
Mid-Ebb	10-Sep-07	11:31	16.7	8.4	27.3	31.2	6.3	8.1	1.2
Mid-Ebb	17-Sep-07	16:01	16.7	8.4	26.8	30.6	6.7	8.2	1.3


M_B		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:26	17.5	8.8	28.0	32.1	6.2	8.1	2.3
Mid-Flood	03-Sep-07	13:26	17.3	8.7	27.5	33.2	6.3	8.2	2.4
Mid-Flood	10-Sep-07	16:26	17.0	8.5	27.2	33.3	6.4	8.2	1.3
Mid-Flood	17-Sep-07	09:56	17.2	8.6	27.2	32.2	6.8	8.4	1.0

M_B		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:30	16.9	15.9	26.3	30.5	6.4	8.3	2.2
Mid-Ebb	03-Sep-07	12:00	17.0	16.0	26.1	30.3	6.3	8.3	2.3
Mid-Ebb	10-Sep-07	11:30	16.7	15.7	27.0	31.3	6.4	8.1	1.1
Mid-Ebb	17-Sep-07	16:00	16.7	15.7	26.9	30.4	6.8	8.2	2.3

M_B		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:25	17.5	16.5	26.0	33.4	6.3	8.2	1.9
Mid-Flood	03-Sep-07	13:25	17.3	16.3	26.2	33.8	6.2	8.2	2.5
Mid-Flood	10-Sep-07	16:25	17.0	16.0	27.0	33.5	6.3	8.2	1.0
Mid-Flood	17-Sep-07	9:55	17.2	16.2	27.0	32.6	6.7	8.4	3.9

M_B	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	2.0	4.0	5.0	3.0	3.0	3.0	3.3
03-Sep-07	2.0	2.0	2.0	5.0	4.0	4.0	3.2
10-Sep-07	6.0	3.0	4.0	3.0	4.0	3.0	3.8
17-Sep-07	2.0	2.0	2.0	2.0	4.0	3.0	2.5

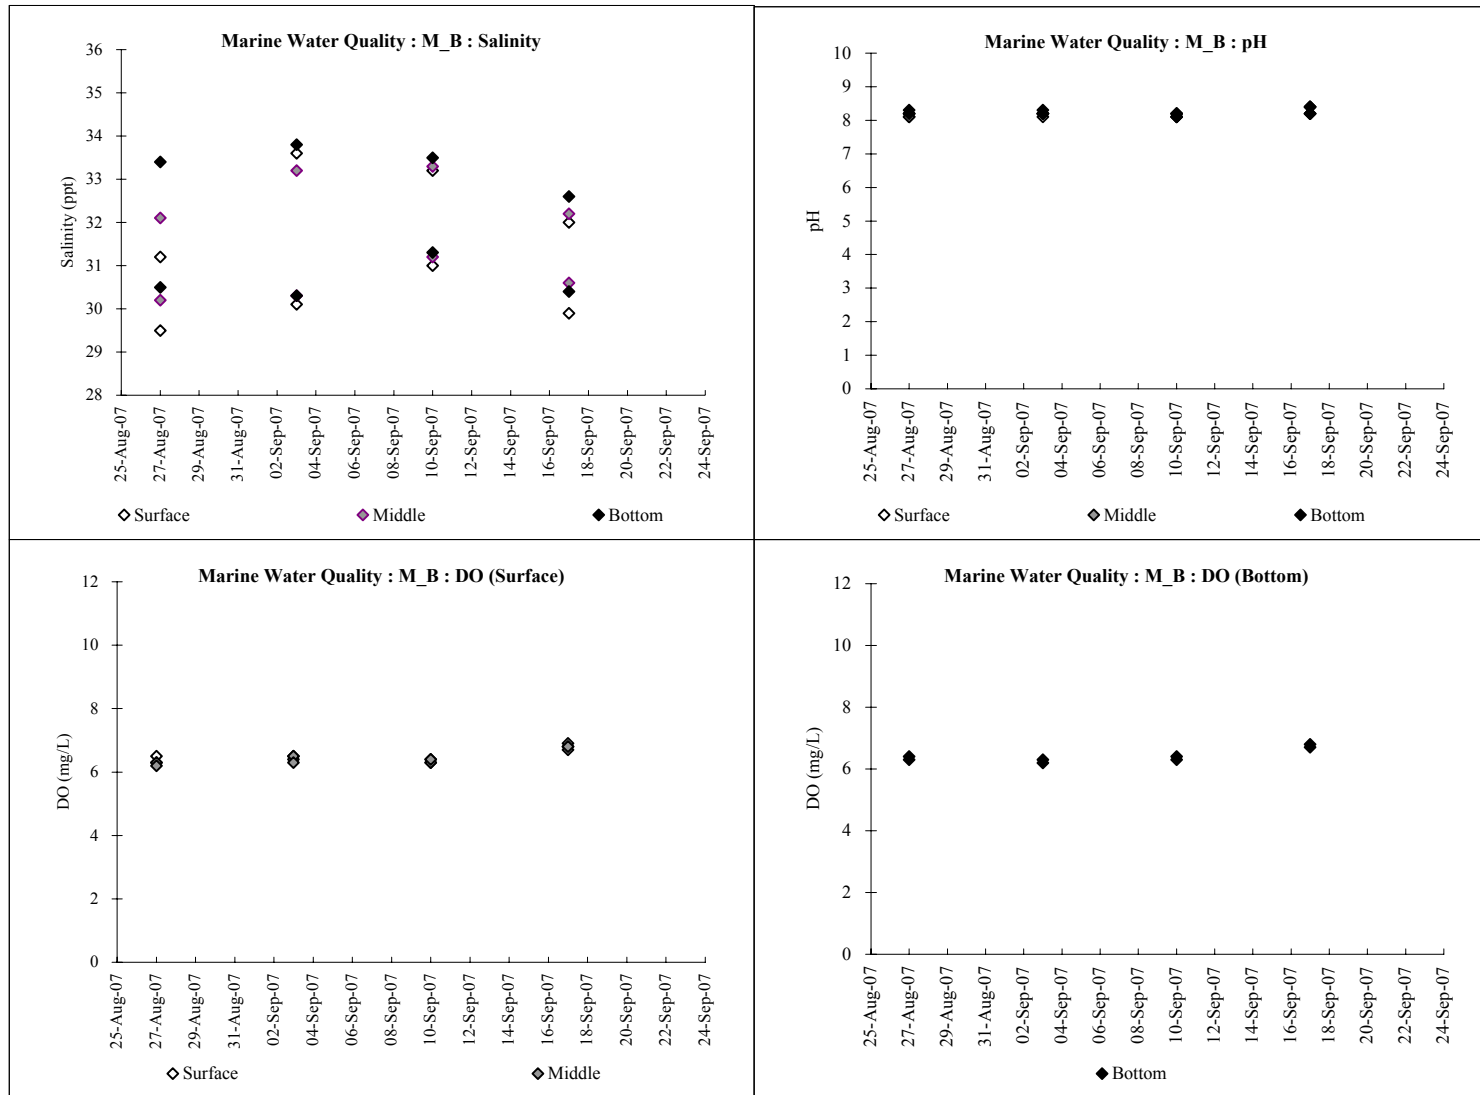

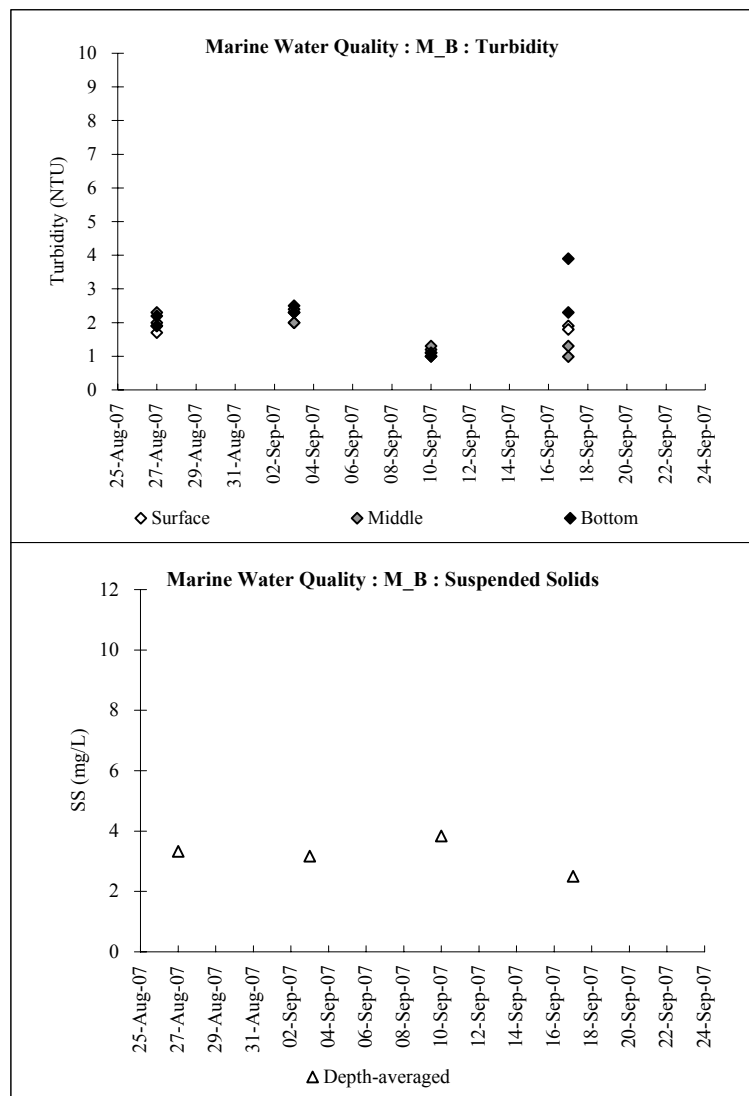

KS		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:52	12.7	1.0	28.3	28.8	6.4	8.3	1.6
Mid-Ebb	03-Sep-07	12:22	12.9	1.0	27.6	29.1	6.3	8.3	1.9
Mid-Ebb	10-Sep-07	11:52	12.6	1.0	27.6	30.1	6.2	8.1	1.3
Mid-Ebb	17-Sep-07	16:22	12.9	1.0	26.8	29.4	6.7	8.2	±0

KS		Surface							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:57	13.4	1.0	27.0	30.2	6.3	8.2	2.0
Mid-Flood	03-Sep-07	13:57	13.6	1.0	28.5	32.0	6.4	8.2	2.2
Mid-Flood	10-Sep-07	16:57	13.3	1.0	27.3	32.6	6.3	8.2	1.1
Mid-Flood	17-Sep-07	10:27	13.6	1.0	27.3	32.0	6.6	8.3	±0

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


KS		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:51	12.7	6.4	27.1	29.3	6.3	8.2	2.2
Mid-Ebb	03-Sep-07	12:21	12.9	6.5	26.9	30.3	6.4	8.2	2.5
Mid-Ebb	10-Sep-07	11:51	12.6	6.3	27.3	30.5	6.2	8.2	1.6
Mid-Ebb	17-Sep-07	16:21	12.9	6.5	26.9	30.1	6.7	8.2	±0


KS		Middle							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:56	13.4	6.7	26.8	32.6	6.2	8.2	1.9
Mid-Flood	03-Sep-07	13:56	13.6	6.8	27.0	33.4	6.3	8.2	2.9
Mid-Flood	10-Sep-07	16:56	13.3	6.7	27.3	32.8	6.4	8.3	1.3
Mid-Flood	17-Sep-07	10:26	13.6	6.8	27.2	32.1	6.6	8.4	±0

KS		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Ebb	27-Aug-07	14:50	12.7	11.7	26.6	30.6	6.3	8.2	2.0
Mid-Ebb	03-Sep-07	12:20	12.9	11.9	26.9	30.6	6.2	8.3	2.1
Mid-Ebb	10-Sep-07	11:50	12.6	11.6	27.2	30.4	6.3	8.1	1.0
Mid-Ebb	17-Sep-07	16:20	12.9	11.9	27.0	30.5	6.6	8.2	1.0

KS		Bottom							
tide condition	Date	time	Water depth (m)	Sampling depth (m)	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)
Mid-Flood	27-Aug-07	16:55	13.4	12.4	26.0	33.6	6.2	8.1	2.3
Mid-Flood	03-Sep-07	13:55	13.6	12.6	27.2	33.6	6.3	8.2	2.4
Mid-Flood	10-Sep-07	16:55	13.3	12.3	27.1	32.9	6.4	8.2	1.0
Mid-Flood	17-Sep-07	10:25	13.6	12.6	27.0	32.8	6.7	8.4	1.1

KS	Mid-Ebb			Mid-Flood			Depth-averaged
	Surface	Middle	Bottom	Surface	Middle	Bottom	SS (mg/L)
27-Aug-07	5.0	2.0	3.0	3.0	4.0	3.0	3.3
03-Sep-07	2.0	2.0	2.0	2.0	3.0	3.0	2.3
10-Sep-07	8.0	10.0	6.0	2.0	2.0	2.0	5.0
17-Sep-07	2.0	2.0	2.0	2.0	2.0	2.0	2.0

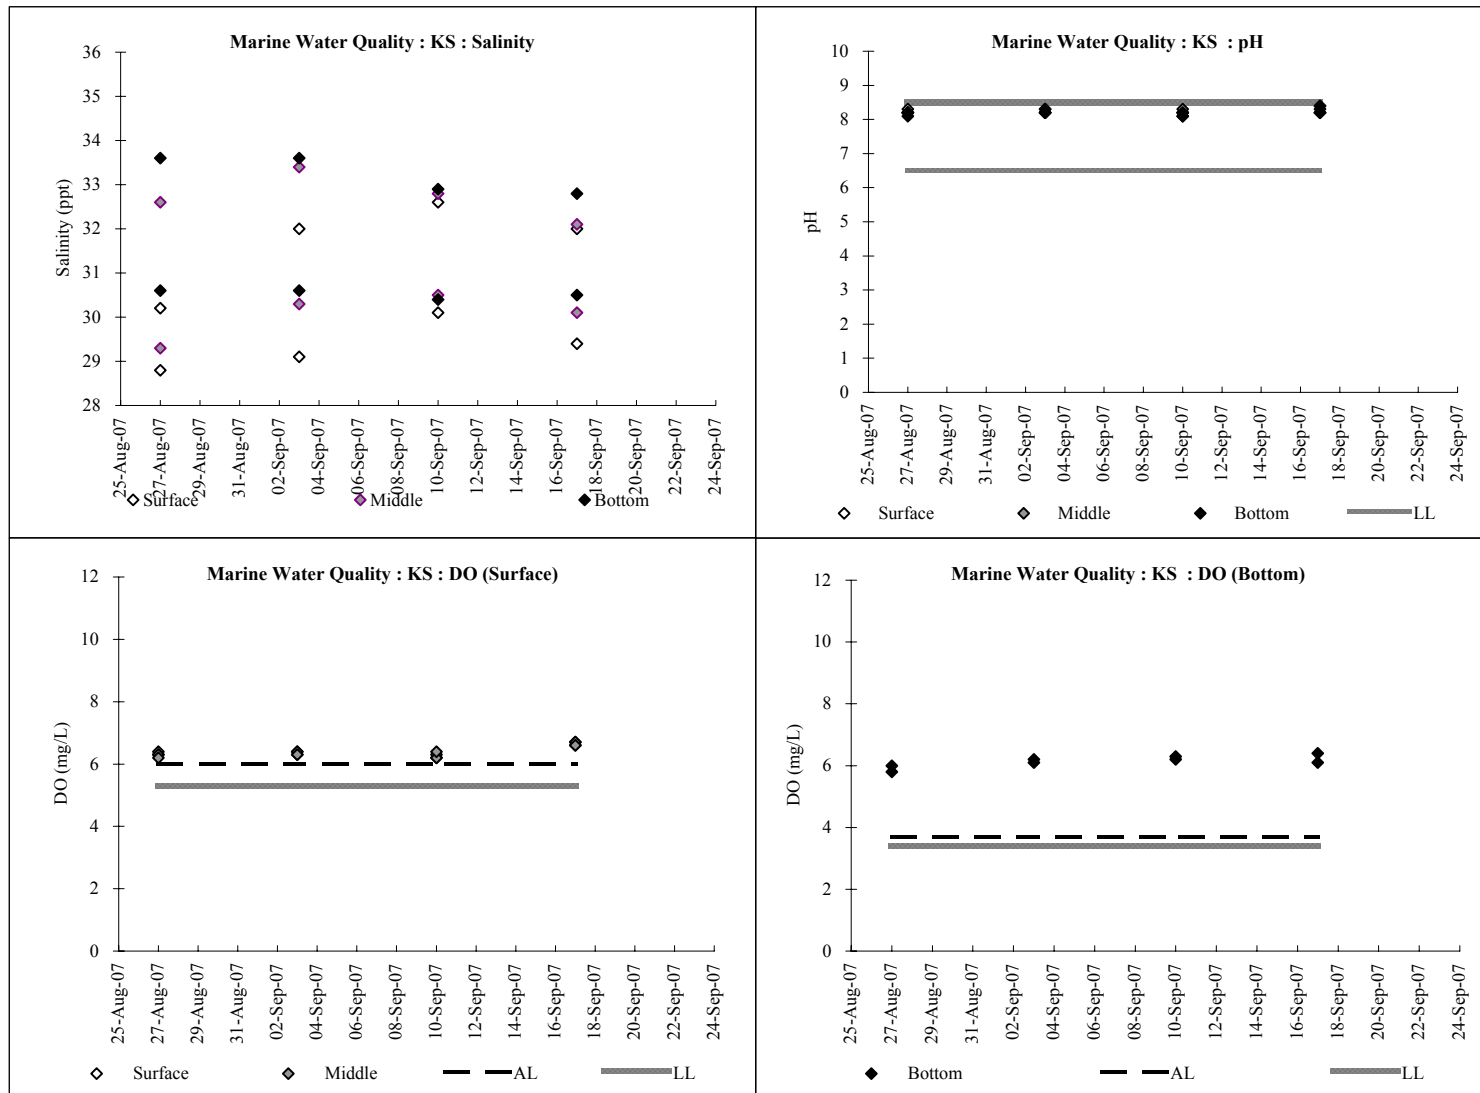

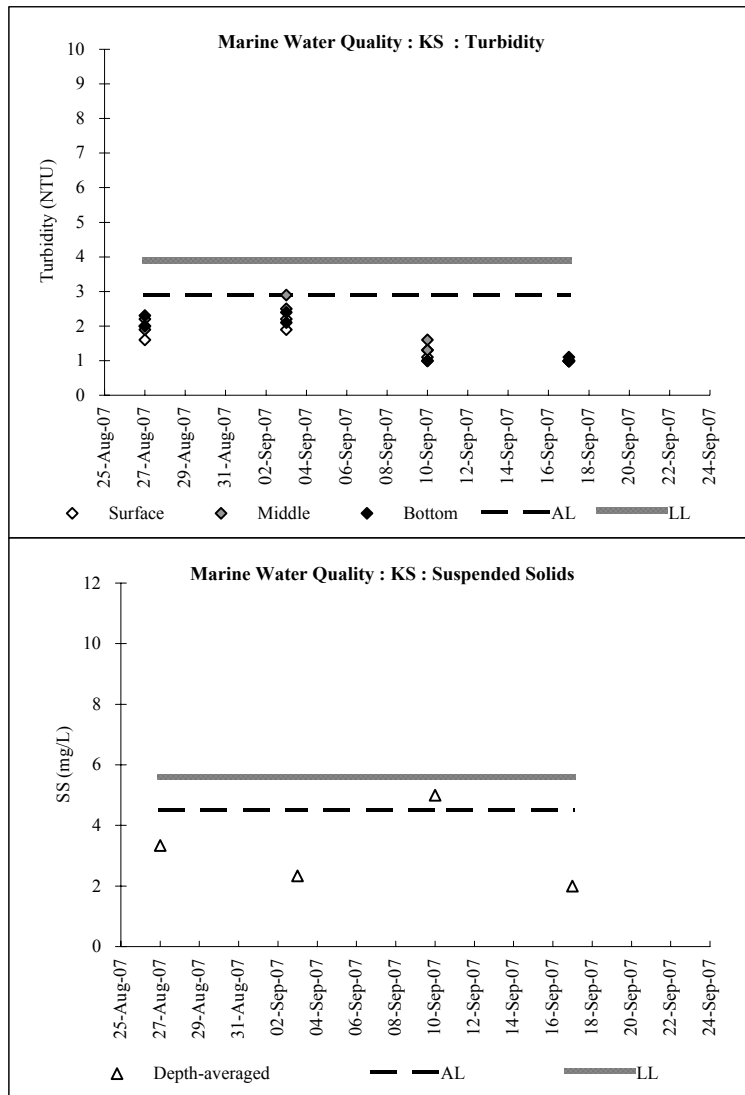


F_UA		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	13:35	25.3	<0.1	8.3	7.6	2.2	2.0
03-Sep-07	11:05	25.0	<0.1	8.4	7.5	2.7	2.0
10-Sep-07	10:35	25.0	<0.1	8.3	7.6	2.3	2.0
17-Sep-07	15:05	25.2	<0.1	8.5	7.6	4.6	2.0

F_DA		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	13:40	25.4	<0.1	8.3	7.7	2.1	2.0
03-Sep-07	11:10	25.3	<0.1	8.3	7.7	3.0	3.0
10-Sep-07	10:40	25.0	<0.1	8.4	7.6	2.3	2.0
17-Sep-07	15:10	25.1	<0.1	8.3	7.7	2.1	2.0

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

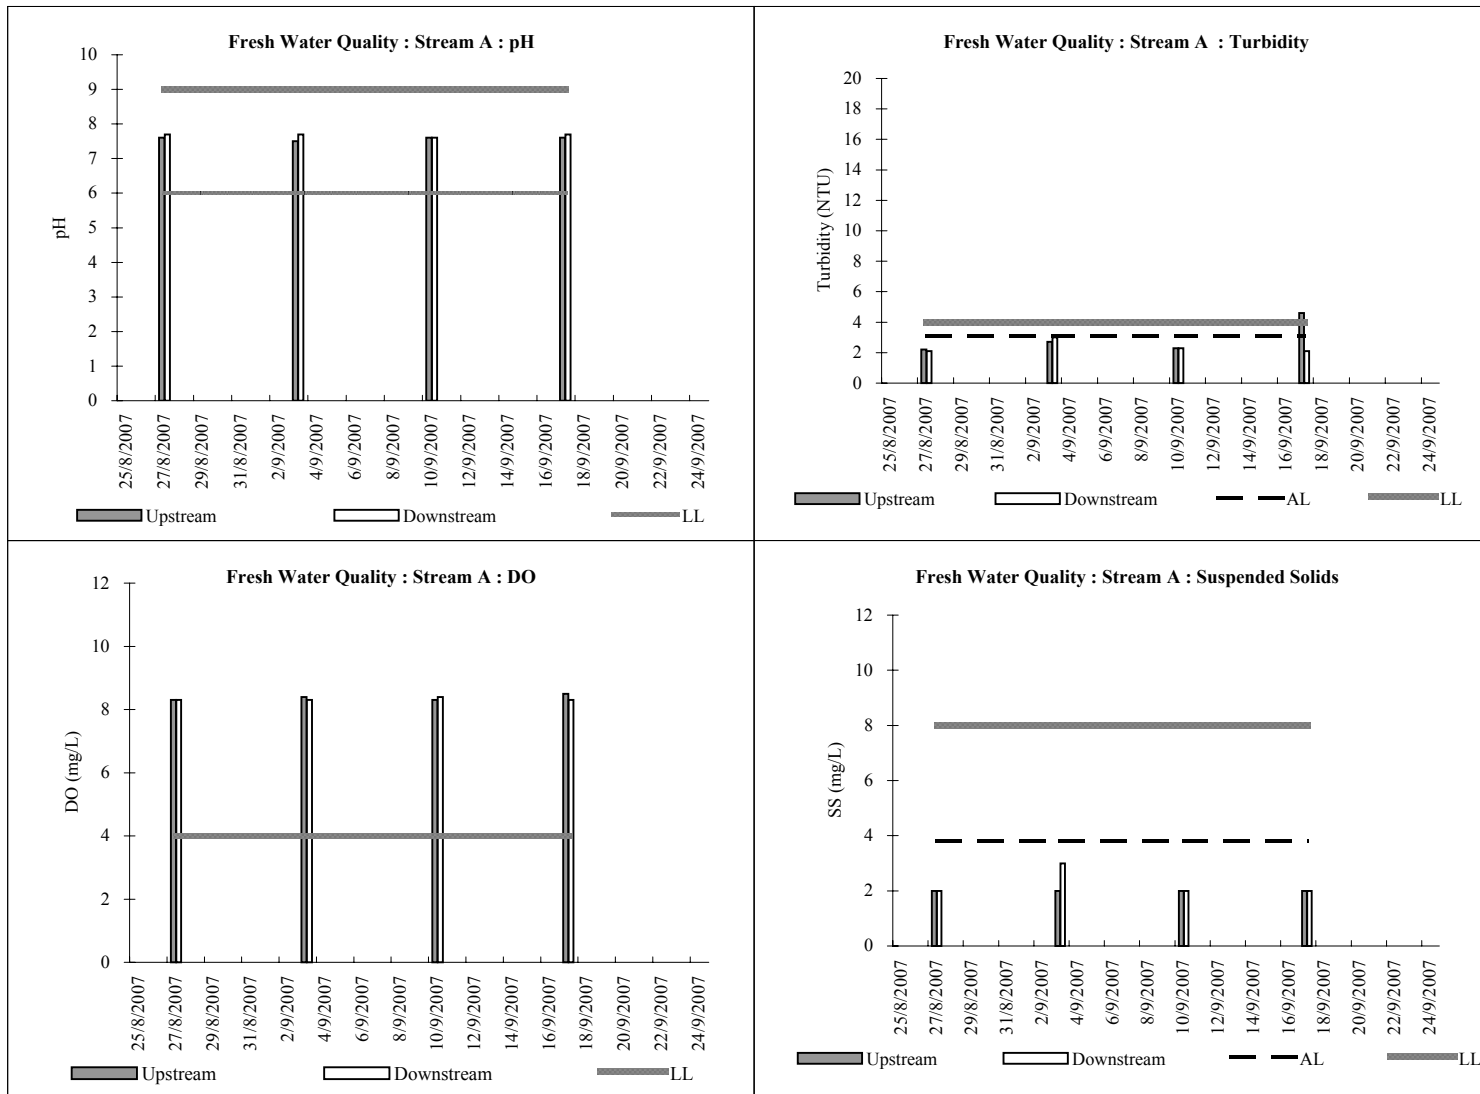


F_UB		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	13:50	25.1	<0.1	8.6	7.3	4.6	3.0
03-Sep-07	11:20	25.2	<0.1	8.5	7.2	4.2	5.0
10-Sep-07	10:50	25.1	<0.1	8.4	7.4	2.2	3.0
17-Sep-07	15:20	25.3	<0.1	8.3	7.4	3.9	4.0

F_DB		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	14:00	25.0	<0.1	8.5	7.5	5.1	6.0
03-Sep-07	11:30	25.2	<0.1	8.4	7.6	4.7	5.0
10-Sep-07	11:00	25.2	<0.1	8.4	7.6	6.8	9.0
17-Sep-07	15:30	25.3	<0.1	8.3	7.6	5.1	6.0

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

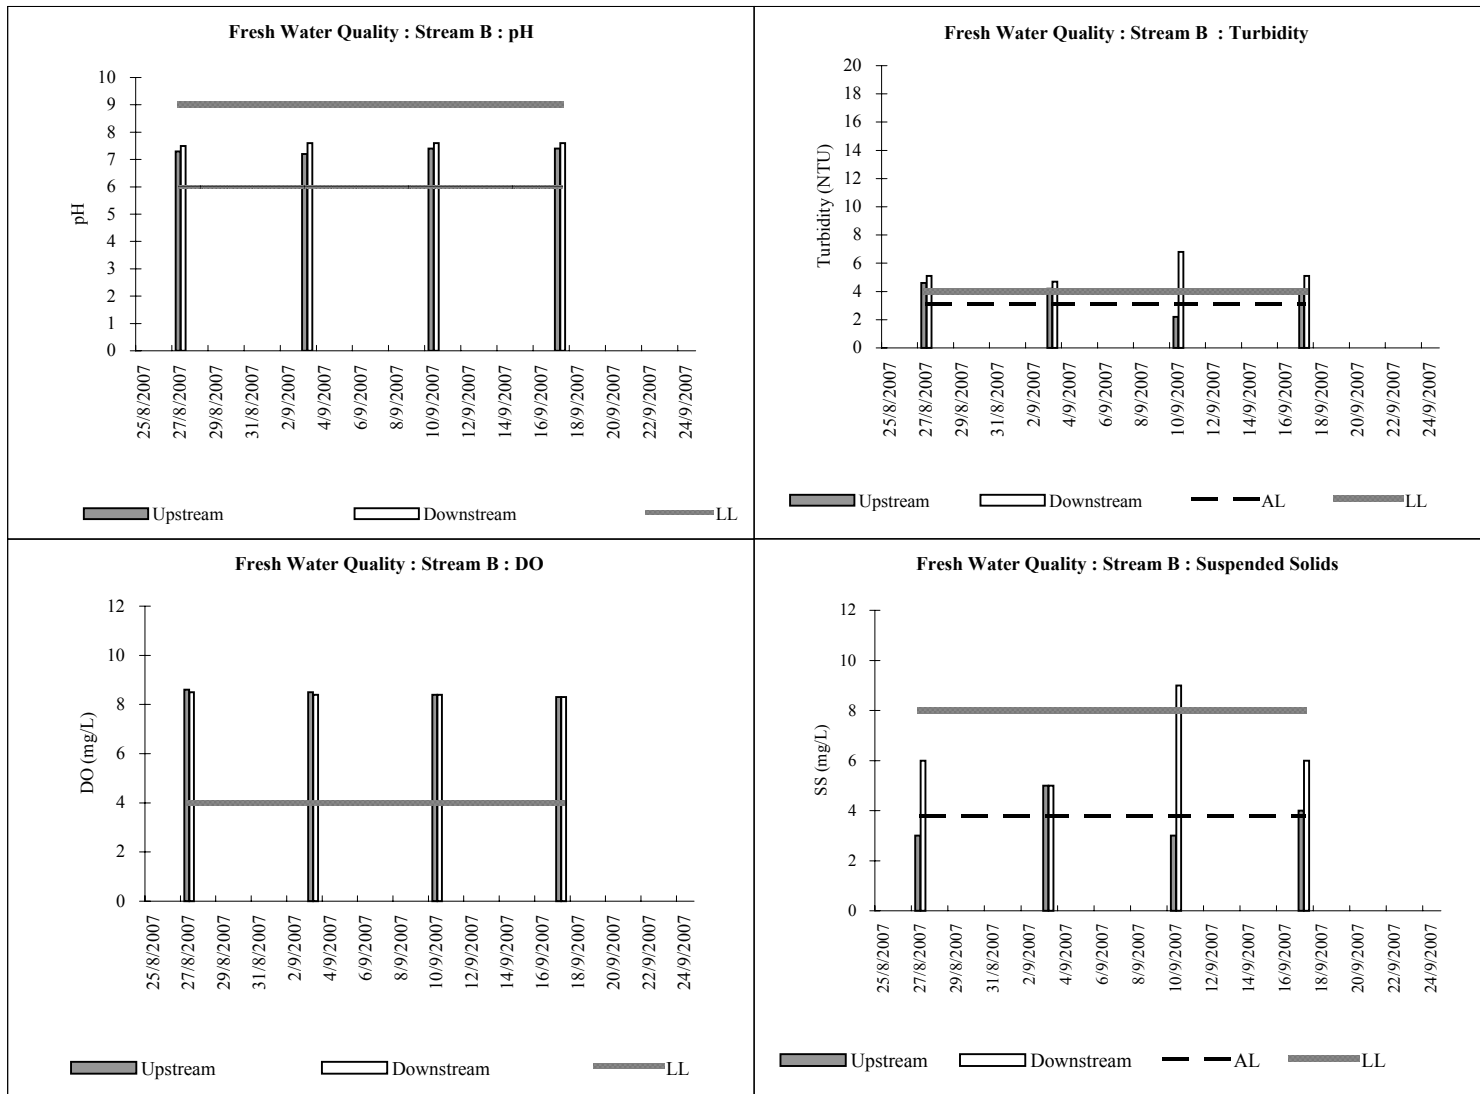


F_UC		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	14:05	25.0	<0.1	8.7	7.0	2.1	3.0
03-Sep-07	11:35	25.0	<0.1	8.8	7.0	3.0	2.0
10-Sep-07	11:05	25.2	<0.1	8.6	6.9	5.1	9.0
17-Sep-07	15:35	25.0	<0.1	8.7	6.8	4.7	7.0

F_DC		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	14:15	24.9	<0.1	8.8	7.4	3.5	4.0
03-Sep-07	11:45	25.0	<0.1	8.6	7.3	5.2	6.0
10-Sep-07	11:15	25.2	<0.1	8.7	7.3	3.7	4.0
17-Sep-07	15:45	25.1	<0.1	8.4	7.2	1.6	2.0

Remarks:


Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

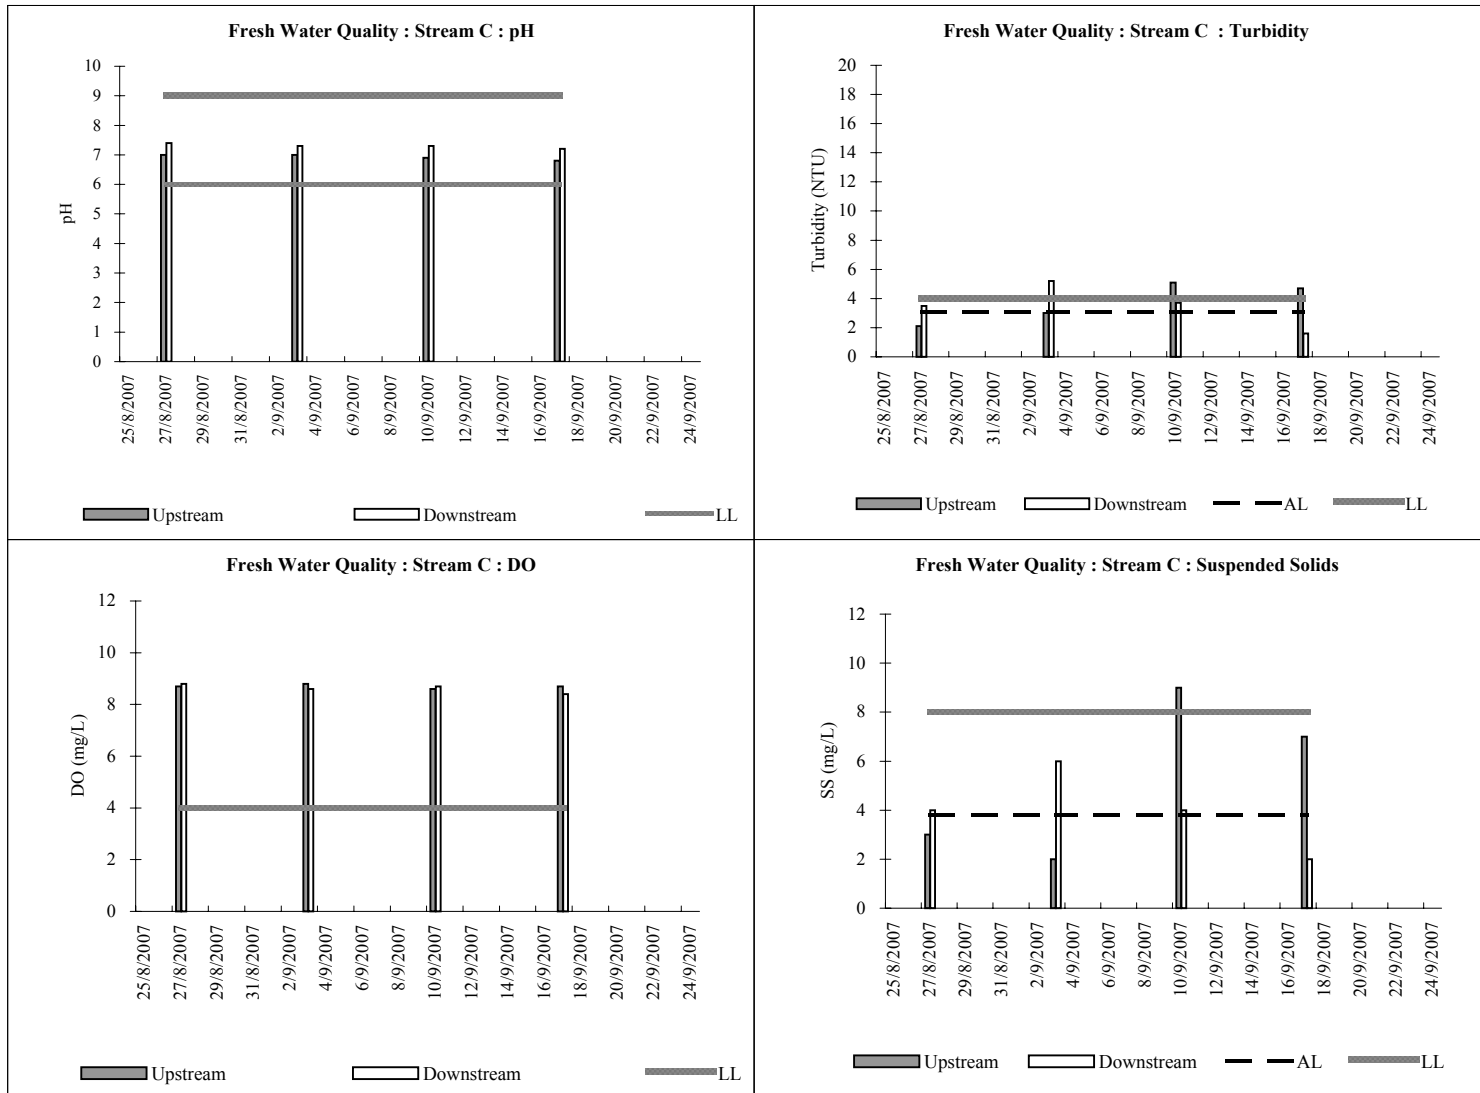

F_Inland M		Mid depth					
Date	time	Temp (°C)	Salinity (ppt)	DO (mg/L)	pH	Turbidity (NTU)	SS (mg/L)
27-Aug-07	12:55	25.3	<0.1	8.2	7.6	1.7	2.0
03-Sep-07	10:25	25.2	<0.1	8.0	7.5	2.2	2.0
10-Sep-07	9:55	25.1	<0.1	8.0	7.6	1.5	3.0
17-Sep-07	14:25	25.3	<0.1	8.1	7.6	2.4	2.0

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

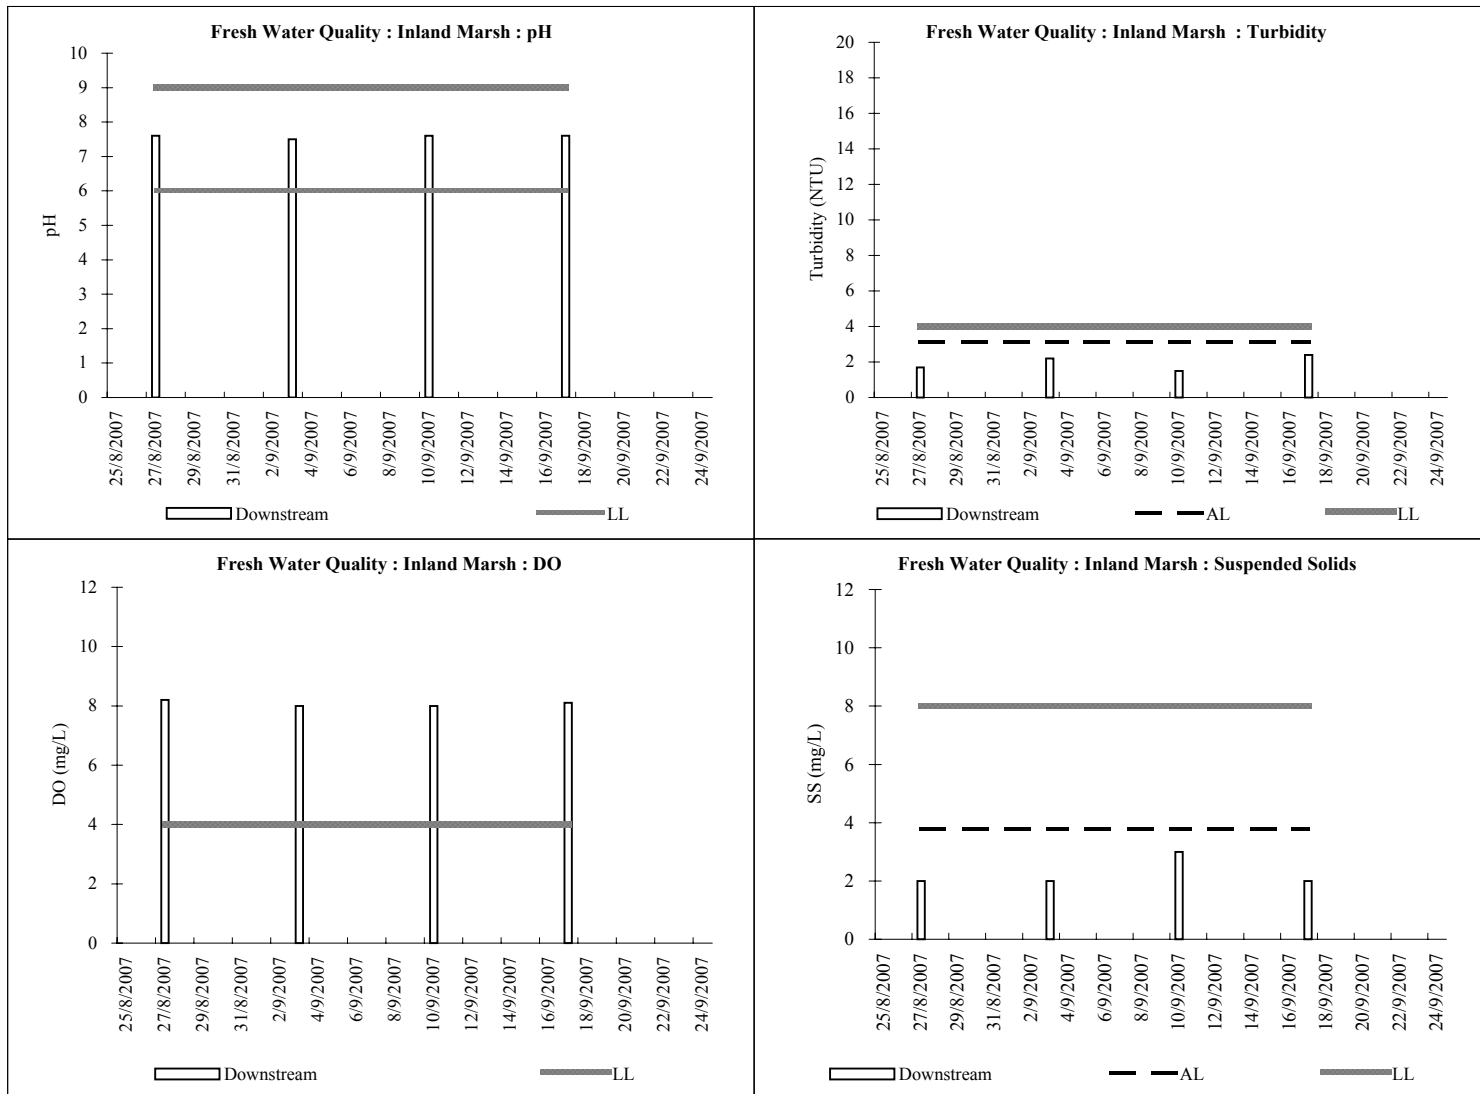

M_A		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	08:27	2.0	0.03	0.01	0.01	0.05	0.01	1.6	
Mid-Ebb	03-Sep-07	09:57	2.0	0.01	0.01	0.01	0.01	0.01	1.9	
Mid-Ebb	10-Sep-07	09:27	4.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	17-Sep-07	13:57	3.0	0.01	0.01	0.01	0.01	0.01	1.5	

M_A		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	15:27	3.0	0.01	0.02	0.01	0.04	0.01	1.4	
Mid-Flood	03-Sep-07	12:27	4.0	0.11	0.01	0.01	0.13	0.01	2.3	
Mid-Flood	10-Sep-07	15:27	3.0	0.04	0.01	0.01	0.06	0.01	1.4	
Mid-Flood	17-Sep-07	08:57	2.0	0.01	0.01	0.01	0.01	0.01	1.3	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_A		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	08:26	4.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	03-Sep-07	09:56	2.0	0.07	0.01	0.01	0.09	0.01	2.0	
Mid-Ebb	10-Sep-07	09:26	3.0	0.01	0.01	0.01	0.01	0.01	1.4	
Mid-Ebb	17-Sep-07	13:56	2.0	0.01	0.01	0.01	0.01	0.01	1.3	


M_A		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	15:26	2.0	0.01	0.02	0.01	0.04	0.01	1.5	
Mid-Flood	03-Sep-07	12:26	5.0	0.01	0.01	0.01	0.01	0.01	1.9	
Mid-Flood	10-Sep-07	15:26	3.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Flood	17-Sep-07	08:56	3.0	0.01	0.01	0.01	0.01	0.01	1.6	

M_A		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	08:25	3.0	0.01	0.02	0.01	0.04	0.01	1.5	
Mid-Ebb	03-Sep-07	09:55	4.0	0.01	0.01	0.01	0.01	0.01	2.0	
Mid-Ebb	10-Sep-07	09:25	6.0	0.04	0.01	0.01	0.06	0.01	1.5	
Mid-Ebb	17-Sep-07	13:55	2.0	0.01	0.01	0.01	0.01	0.01	1.4	

M_A		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	15:25	2.0	0.31	0.02	0.01	0.34	0.01	1.6	
Mid-Flood	03-Sep-07	12:25	5.0	0.01	0.01	0.01	0.01	0.01	2.0	
Mid-Flood	10-Sep-07	15:25	4.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Flood	17-Sep-07	08:55	4.0	0.02	0.01	0.01	0.04	0.01	1.4	

M_A	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	3	0.06	0.02	0.01	0.09	0.01	1.5	
03-Sep-07	4	0.04	0.01	0.01	0.04	0.01	2.0	
10-Sep-07	4	0.02	0.01	0.01	0.03	0.01	1.5	
17-Sep-07	3	0.01	0.01	0.01	0.01	0.01	1.4	

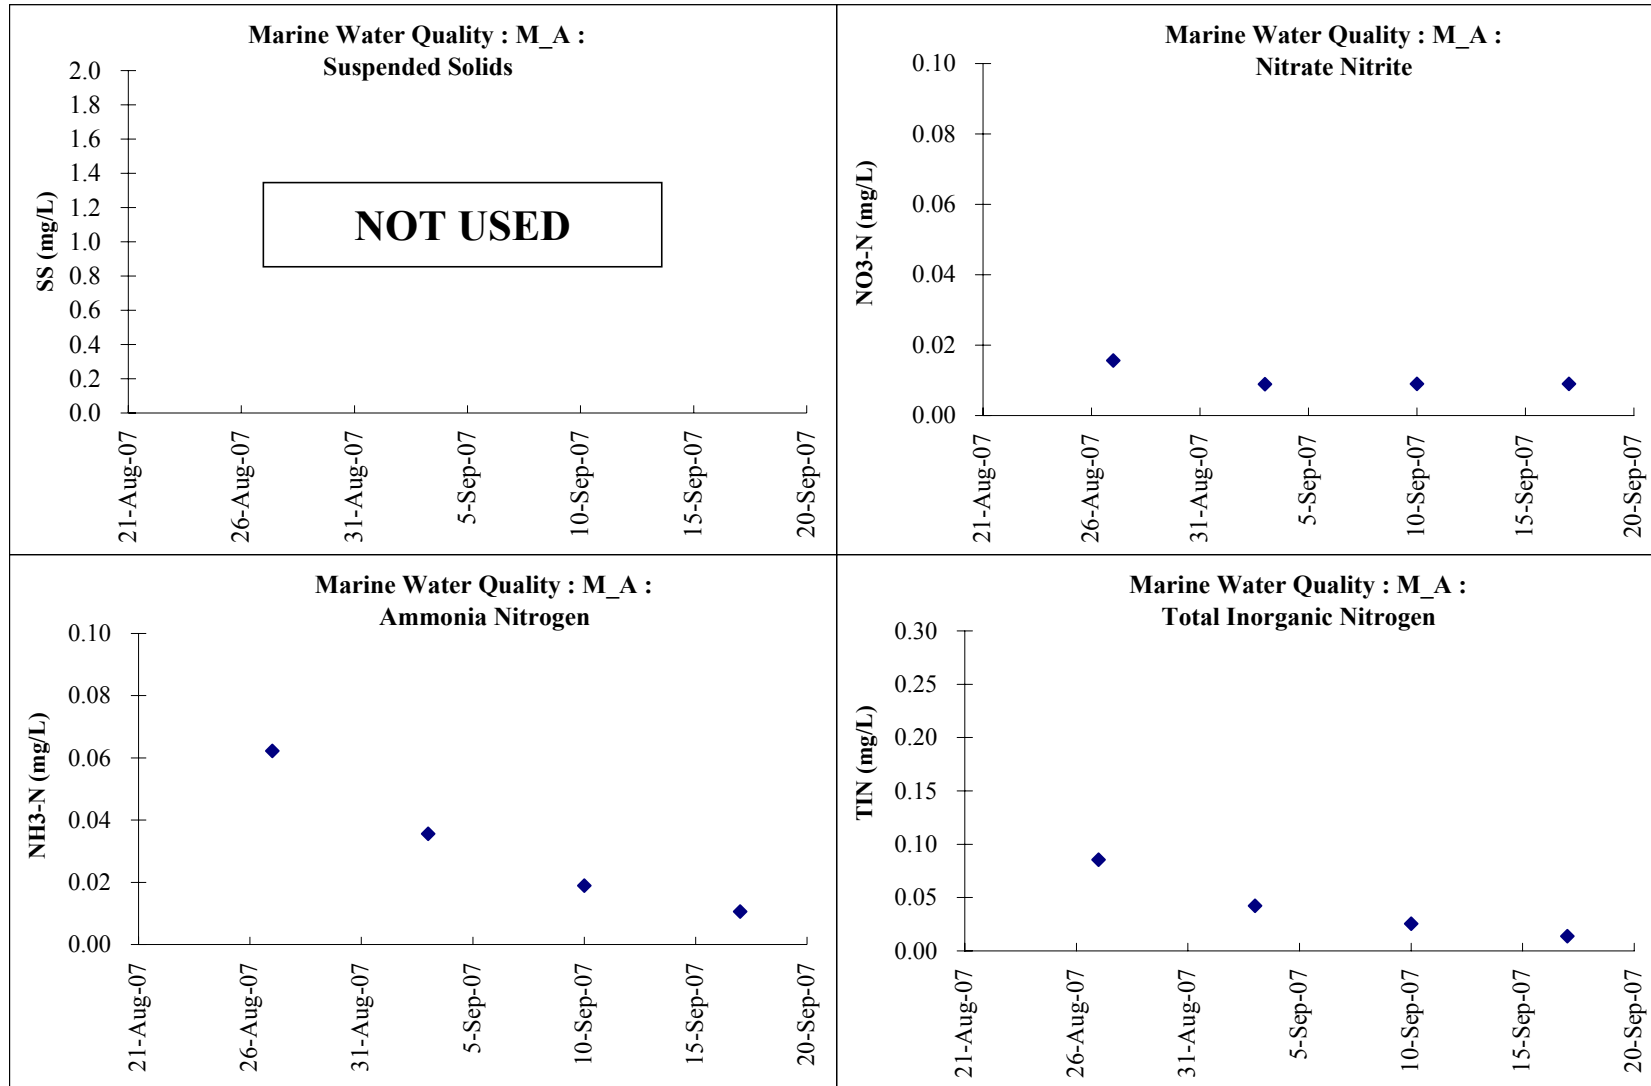

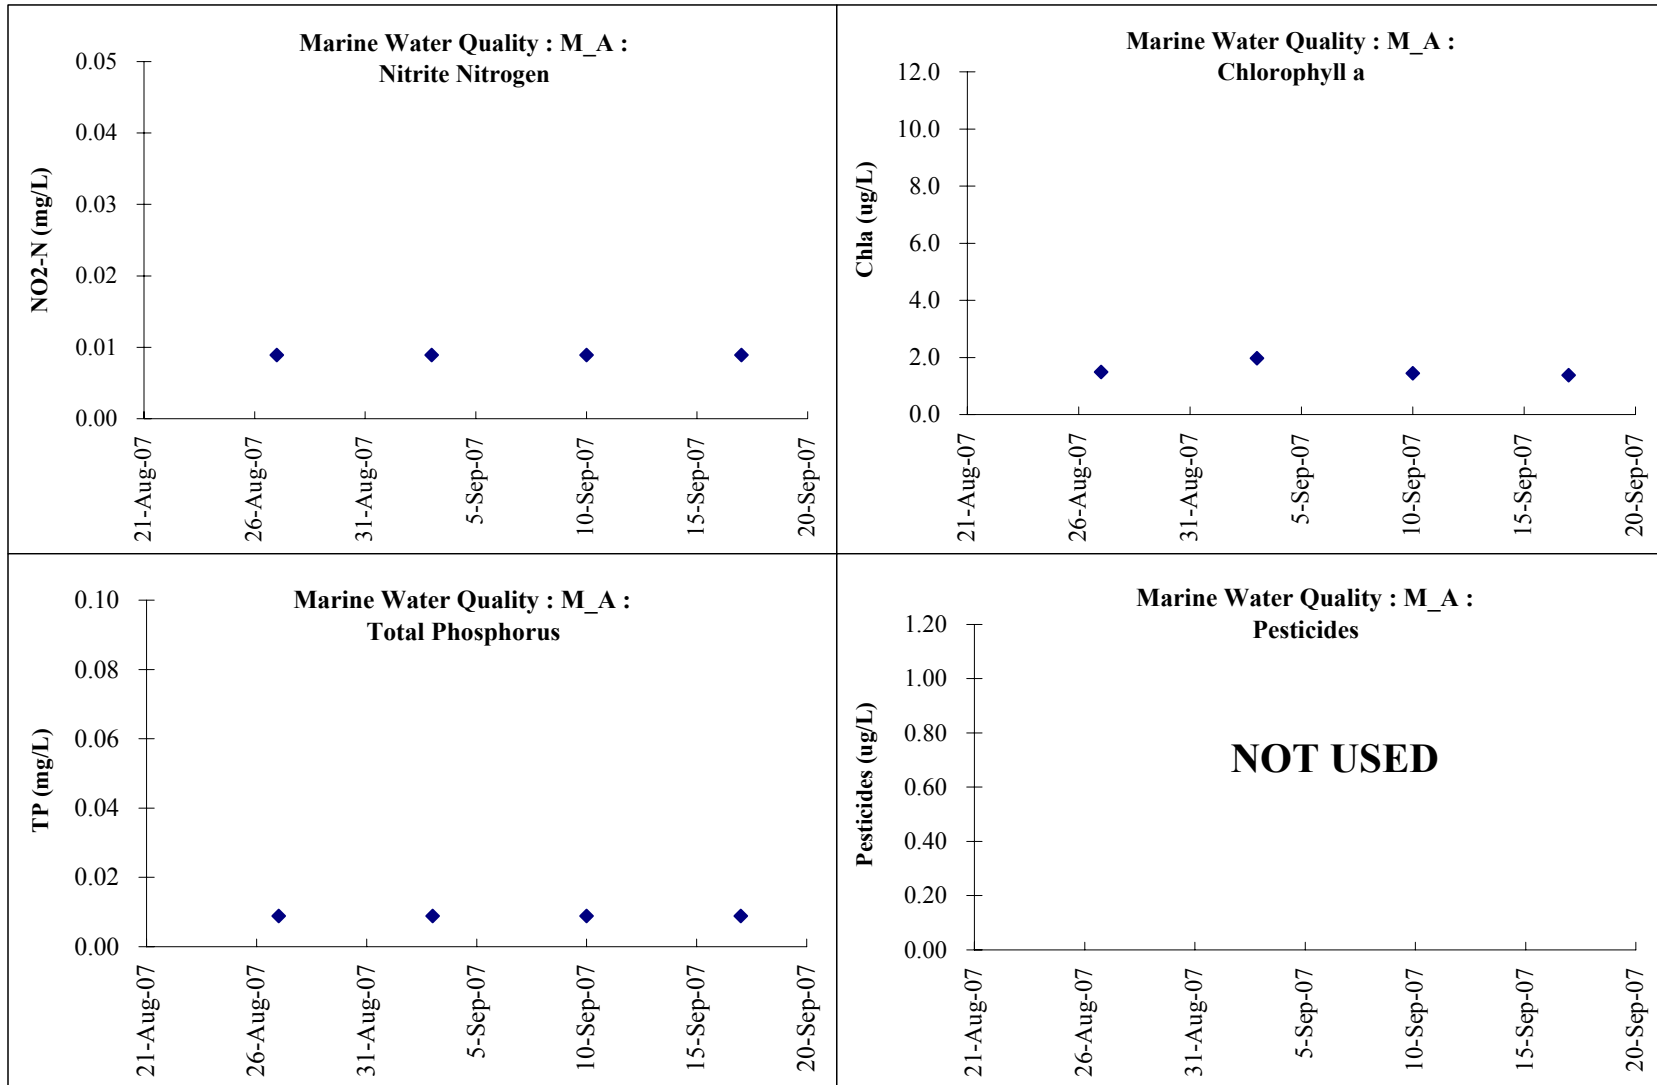

M_Marsh		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	08:37	9	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Ebb	03-Sep-07	10:07	3	0.03	0.01	0.01	0.05	0.01	2.0	
Mid-Ebb	10-Sep-07	09:37	2	0.01	0.01	0.01	0.01	0.01	1.0	
Mid-Ebb	17-Sep-07	14:07	2	0.01	0.01	0.01	0.01	0.01	12.3	

M_Marsh		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	15:37	3	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Flood	03-Sep-07	12:37	4	0.01	0.01	0.01	0.01	0.01	2.0	
Mid-Flood	10-Sep-07	15:37	8	0.01	0.01	0.01	0.01	0.01	1.1	
Mid-Flood	17-Sep-07	09:07	3	0.01	0.01	0.01	0.01	0.01	10.5	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_Marsh	Middle									
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	08:36	5	0.01	0.02	0.01	0.04	0.01	1.0	
Mid-Ebb	03-Sep-07	10:06	3	0.08	0.01	0.01	0.10	0.01	2.0	
Mid-Ebb	10-Sep-07	09:36	2	0.01	0.01	0.01	0.01	0.01	1.1	
Mid-Ebb	17-Sep-07	14:06	2	0.01	0.01	0.01	0.01	0.01	10.8	


M_Marsh	Middle									
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	15:36	4	0.01	0.02	0.01	0.04	0.01	0.7	
Mid-Flood	03-Sep-07	12:36	4	0.01	0.01	0.01	0.01	0.01	1.7	
Mid-Flood	10-Sep-07	15:36	4	0.02	0.01	0.01	0.04	0.01	0.9	
Mid-Flood	17-Sep-07	09:06	4	0.01	0.01	0.01	0.01	0.01	8.4	

M_Marsh		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	08:35	4	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Ebb	03-Sep-07	10:05	2	0.01	0.01	0.01	0.01	0.01	1.8	
Mid-Ebb	10-Sep-07	09:35	4	0.01	0.01	0.01	0.01	0.01	1.0	
Mid-Ebb	17-Sep-07	14:05	2	0.01	0.01	0.01	0.01	0.01	11.2	

M_Marsh		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	15:35	6	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Flood	03-Sep-07	12:35	4	0.01	0.01	0.01	0.01	0.01	2.0	
Mid-Flood	10-Sep-07	15:35	6	0.02	0.01	0.01	0.04	0.01	1.0	
Mid-Flood	17-Sep-07	09:05	6	0.01	0.01	0.01	0.01	0.01	10.6	

M_Marsh	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	5	0.01	0.02	0.01	0.04	0.01	1.0	
03-Sep-07	3	0.02	0.01	0.01	0.03	0.01	1.9	
10-Sep-07	4	0.01	0.01	0.01	0.02	0.01	1.0	
17-Sep-07	3	0.01	0.01	0.01	0.01	0.01	10.6	

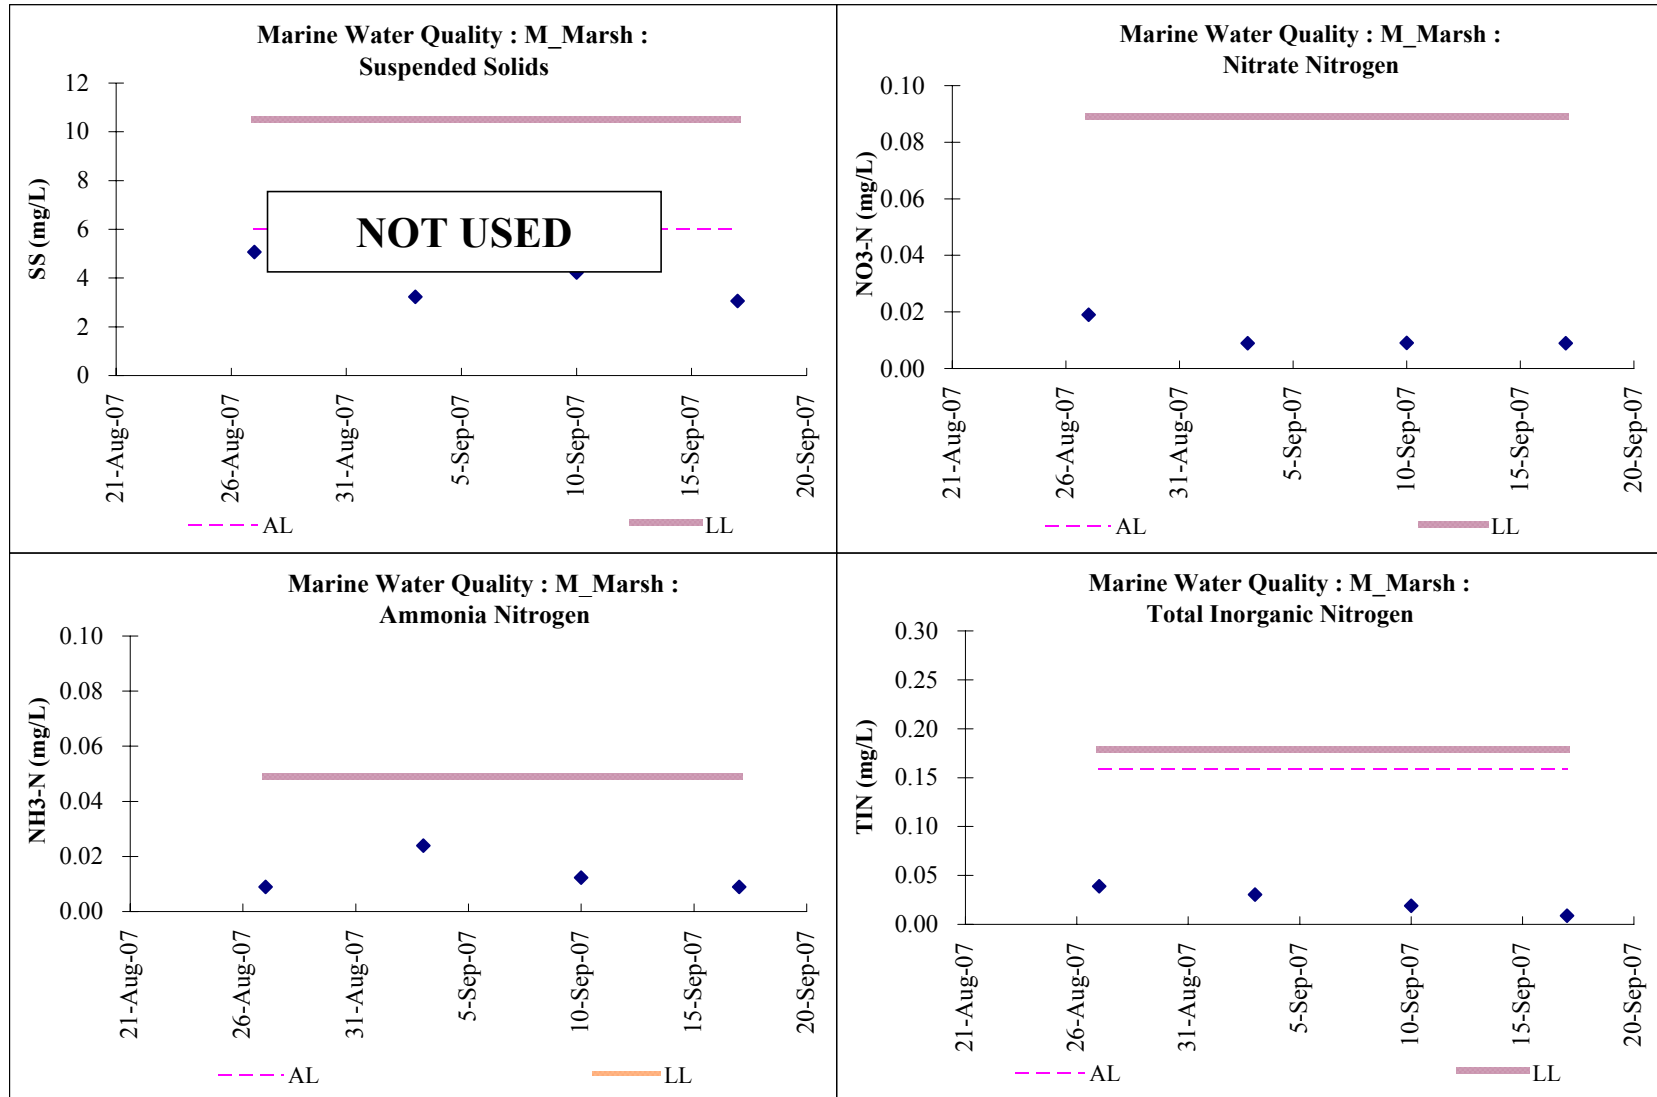

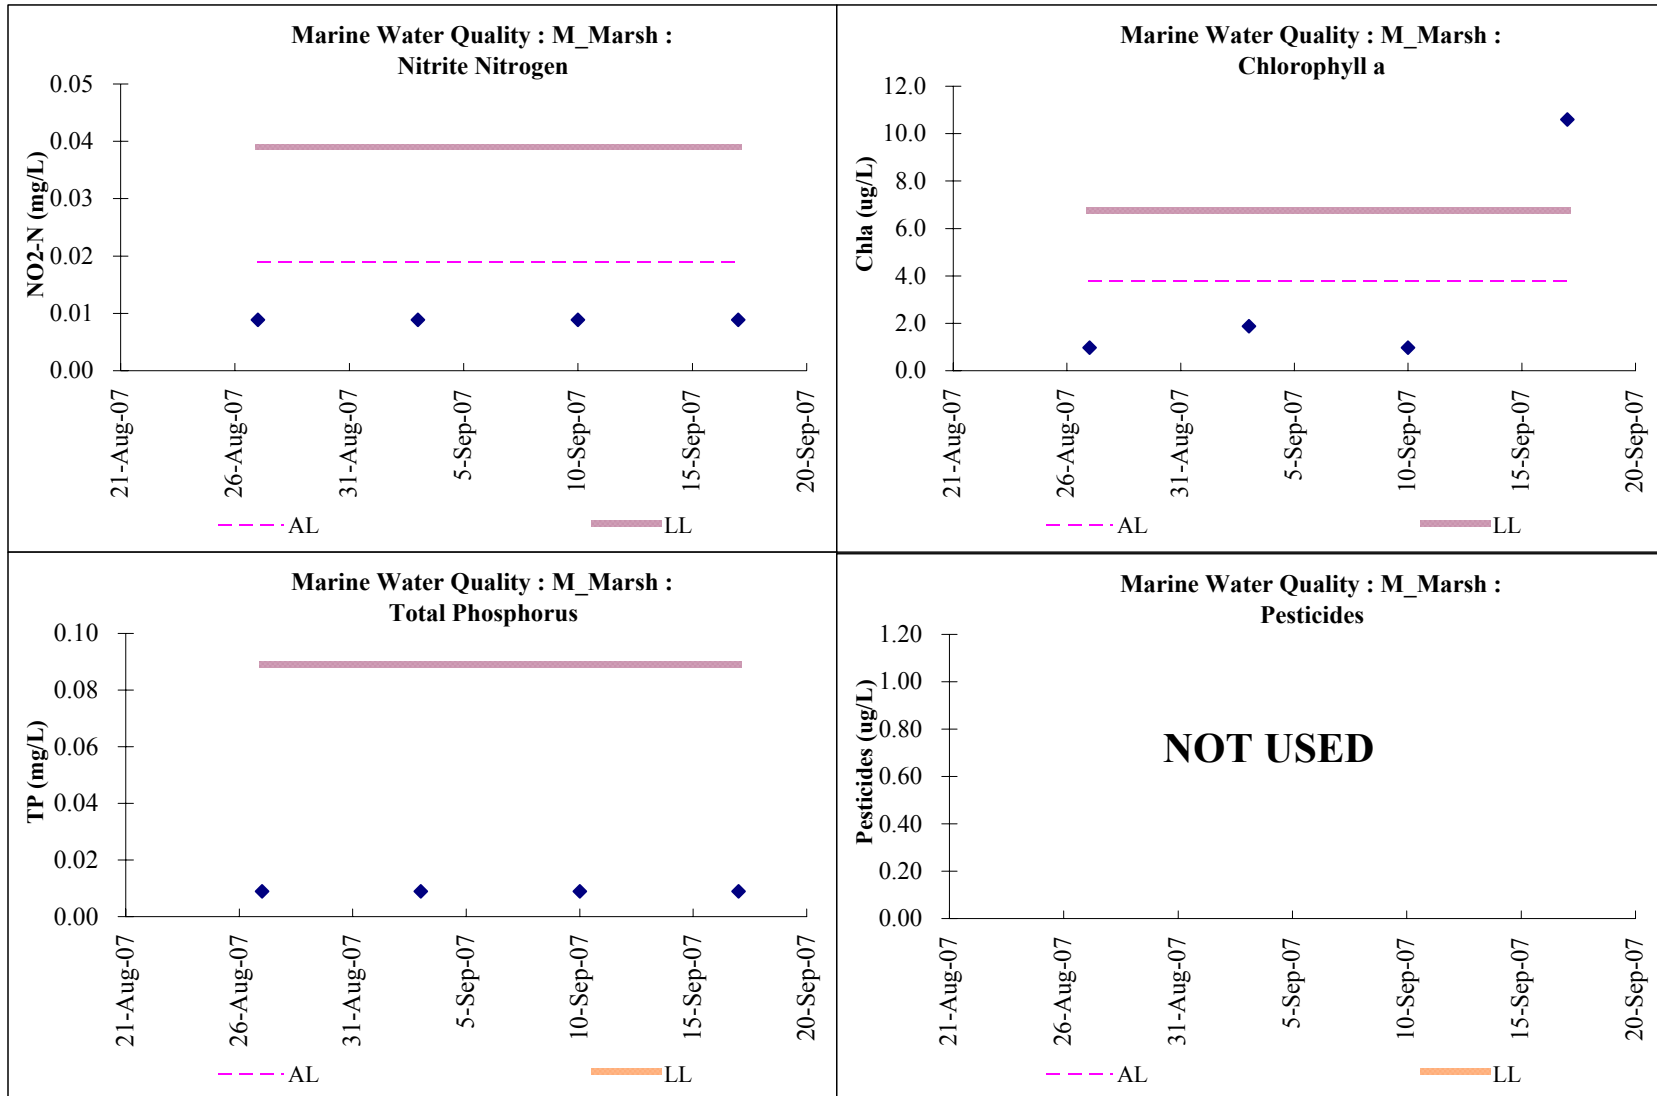

TTC		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	15:47	2.0	0.01	0.01	0.01	0.01	0.01	1.1	
Mid-Ebb	03-Sep-07	12:47	2.0	0.04	0.01	0.01	0.06	0.01	1.2	
Mid-Ebb	10-Sep-07	15:47	8.0	0.01	0.01	0.01	0.01	0.01	2.5	
Mid-Ebb	17-Sep-07	09:17	2.0	0.01	0.01	0.01	0.01	0.01	6.0	

TTC		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	08:57	4.0	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Flood	03-Sep-07	10:27	3.0	0.10	0.01	0.01	0.12	0.01	1.1	
Mid-Flood	10-Sep-07	09:57	6.0	0.01	0.01	0.01	0.01	0.01	2.7	
Mid-Flood	17-Sep-07	14:27	4.0	0.01	0.02	0.01	0.04	0.01	7.1	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


TTC		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	15:46	4.0	0.0±	0.02	0.0±	0.04	0.0±	1.1	
Mid-Ebb	03-Sep-07	12:46	2.0	0.0±	0.01	0.0±	0.0±	0.0±	1.2	
Mid-Ebb	10-Sep-07	15:46	4.0	0.01	0.01	0.0±	0.0±	0.0±	2.8	
Mid-Ebb	17-Sep-07	09:16	2.0	0.0±	0.01	0.0±	0.0±	0.0±	6.7	


TTC		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	08:56	2.0	0.0±	0.02	0.0±	0.04	0.0±	1.0	
Mid-Flood	03-Sep-07	10:26	2.0	0.0±	0.01	0.0±	0.0±	0.0±	1.2	
Mid-Flood	10-Sep-07	09:56	4.0	0.02	0.01	0.0±	0.04	0.0±	2.5	
Mid-Flood	17-Sep-07	14:26	4.0	0.0±	0.01	0.0±	0.0±	0.0±	7.1	

TTC		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	15:45	3.0	0.0±	0.02	0.0±	0.04	0.0±	1.1	
Mid-Ebb	03-Sep-07	12:45	2.0	0.10	0.01	0.0±	0.12	0.0±	1.3	
Mid-Ebb	10-Sep-07	15:45	4.0	0.0±	0.01	0.0±	0.0±	0.0±	2.4	
Mid-Ebb	17-Sep-07	09:15	3.0	0.0±	0.01	0.0±	0.0±	0.0±	7.0	

TTC		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	08:55	2.0	0.0±	0.02	0.0±	0.04	0.0±	1.1	
Mid-Flood	03-Sep-07	10:25	6.0	0.0±	0.01	0.0±	0.0±	0.0±	1.2	
Mid-Flood	10-Sep-07	09:55	6.0	0.04	0.01	0.0±	0.06	0.0±	2.8	
Mid-Flood	17-Sep-07	14:25	2.0	0.0±	0.01	0.0±	0.0±	0.0±	7.2	

TTC	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	3	0.01	0.02	0.01	0.03	0.01	1.1	
03-Sep-07	3	0.04	0.01	0.01	0.05	0.01	1.2	
10-Sep-07	5	0.02	0.01	0.01	0.02	0.01	2.6	
17-Sep-07	3	0.01	0.01	0.01	0.01	0.01	6.9	

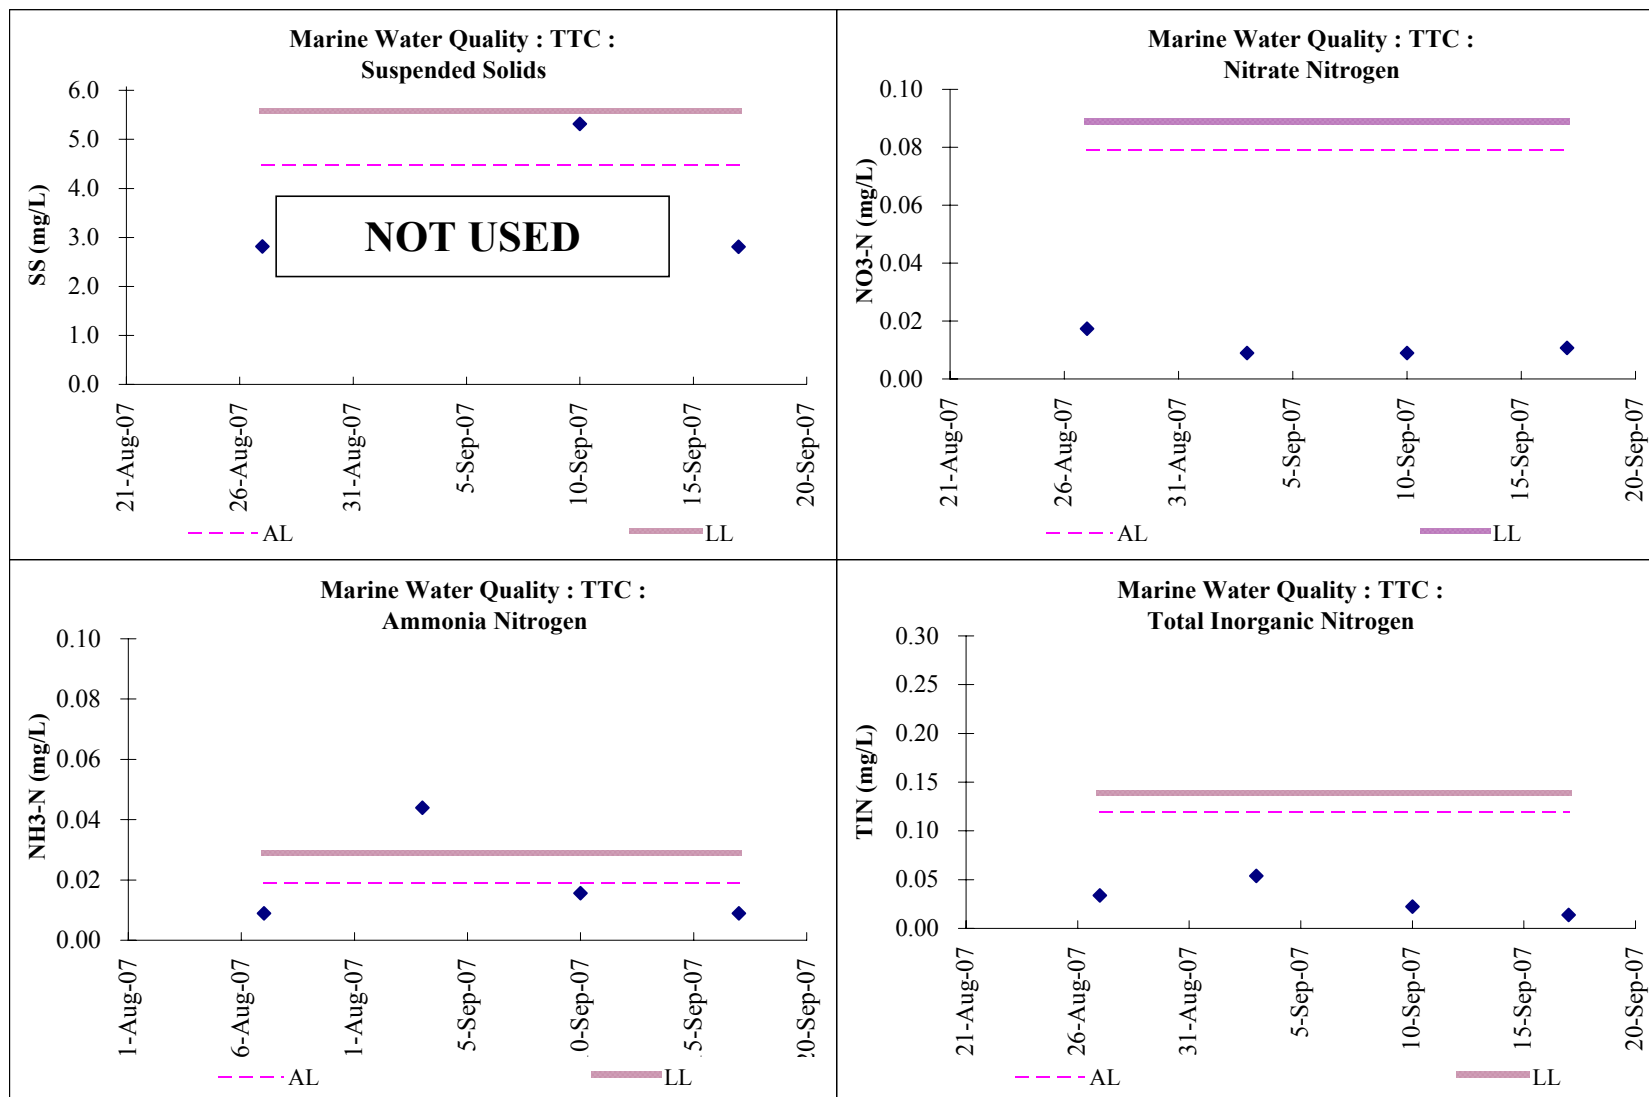

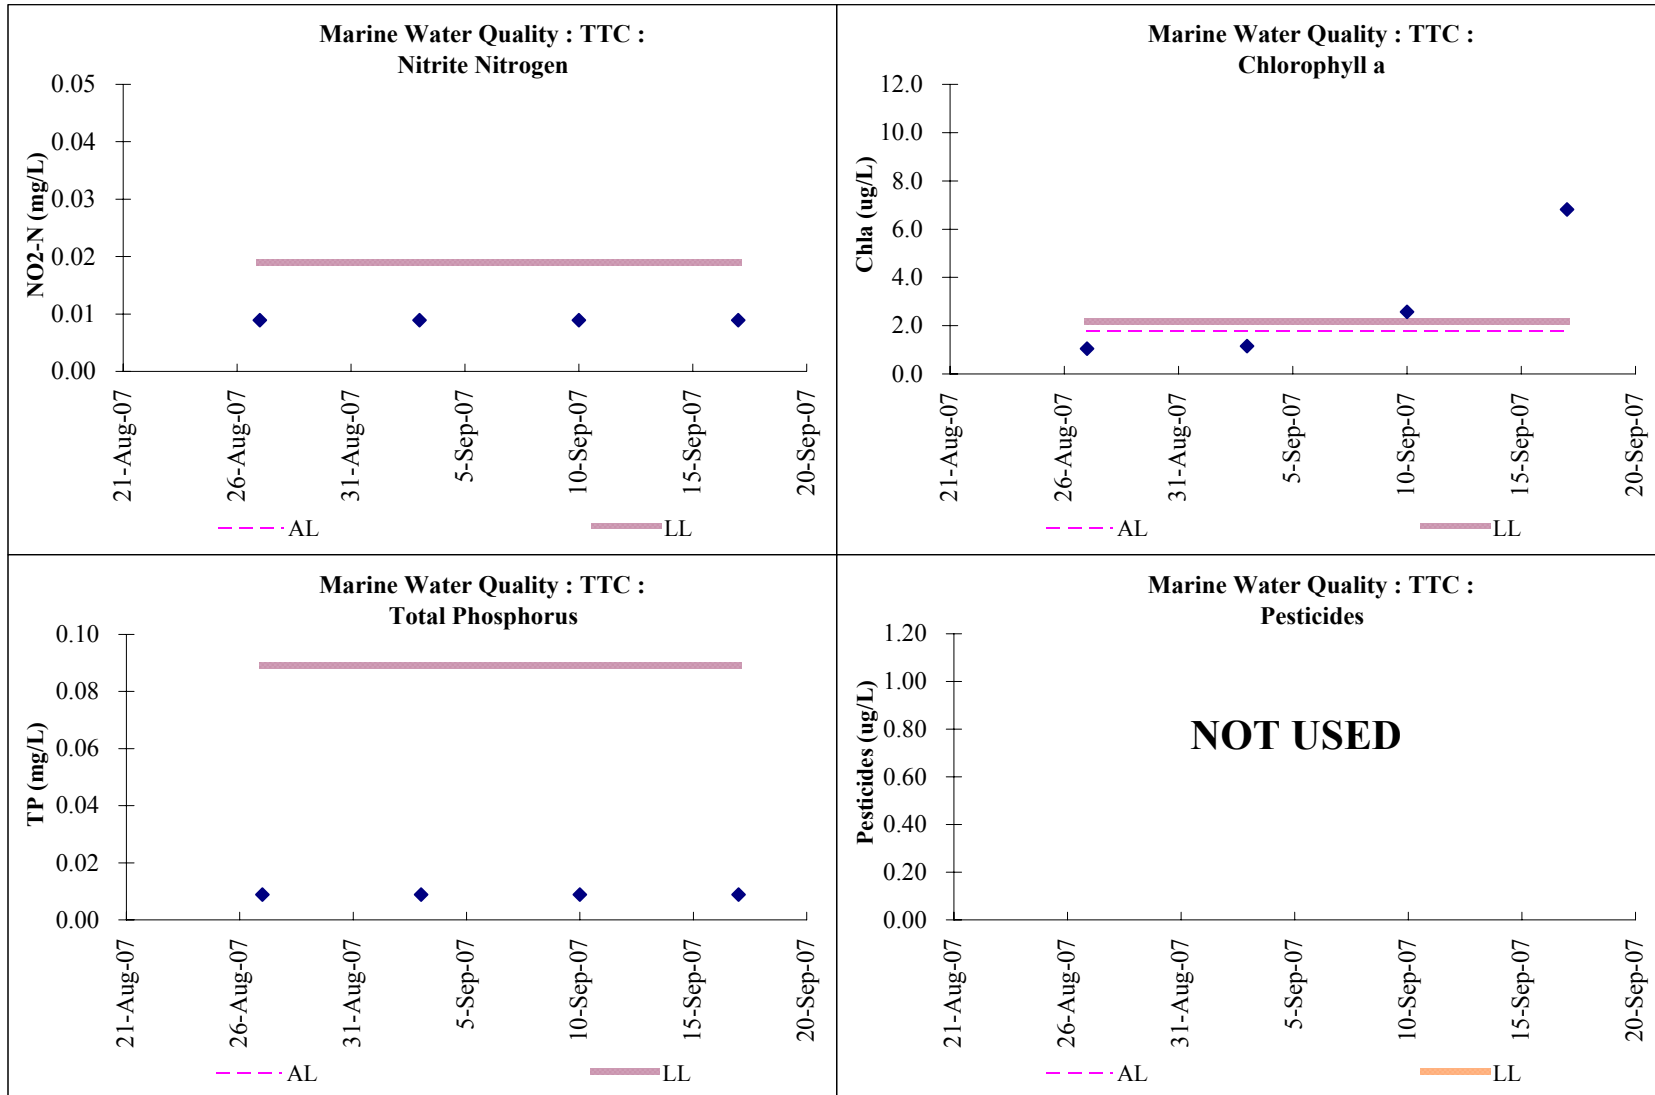

M_BP		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	15:57	4	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Ebb	03-Sep-07	12:57	2	0.06	0.01	0.01	0.08	0.01	1.1	
Mid-Ebb	10-Sep-07	15:57	7	0.01	0.01	0.01	0.01	0.01	2.7	
Mid-Ebb	17-Sep-07	09:27	2	0.01	0.01	0.01	0.01	0.01	2.9	

M_BP		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	09:07	2	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Flood	03-Sep-07	10:37	2	0.08	0.01	0.01	0.10	0.01	1.2	
Mid-Flood	10-Sep-07	10:07	5	0.01	0.01	0.01	0.01	0.01	3.0	
Mid-Flood	17-Sep-07	14:37	2	0.01	0.01	0.01	0.01	0.01	2.8	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_BP		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	15:56	5	0.01	0.02	0.01	0.04	0.01	1.2	
Mid-Ebb	03-Sep-07	12:56	3	0.01	0.01	0.01	0.01	0.01	1.3	
Mid-Ebb	10-Sep-07	15:56	9	0.01	0.01	0.01	0.01	0.01	2.4	
Mid-Ebb	17-Sep-07	09:26	2	0.01	0.01	0.01	0.01	0.01	2.9	


M_BP		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	09:06	3	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Flood	03-Sep-07	10:36	3	0.01	0.01	0.01	0.01	0.01	1.2	
Mid-Flood	10-Sep-07	10:06	7	0.02	0.01	0.01	0.04	0.01	2.2	
Mid-Flood	17-Sep-07	14:36	4	0.01	0.01	0.01	0.01	0.01	2.9	

M_BP		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	15:55	5	0.01	0.01	0.01	0.01	0.01	1.1	
Mid-Ebb	03-Sep-07	12:55	4	0.01	0.01	0.01	0.01	0.01	1.1	
Mid-Ebb	10-Sep-07	15:55	6	0.01	0.01	0.01	0.01	0.01	2.8	
Mid-Ebb	17-Sep-07	09:25	2	0.01	0.01	0.01	0.01	0.01	2.7	

M_BP		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	09:05	5	0.01	0.02	0.01	0.04	0.01	1.1	
Mid-Flood	03-Sep-07	10:35	3	0.07	0.01	0.01	0.09	0.01	1.1	
Mid-Flood	10-Sep-07	10:05	4	0.01	0.01	0.01	0.01	0.01	2.2	
Mid-Flood	17-Sep-07	14:35	4	0.01	0.01	0.01	0.01	0.01	2.8	

M_BP	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	4	0.01	0.02	0.01	0.03	0.01	1.1	
03-Sep-07	3	0.04	0.01	0.01	0.05	0.01	1.2	
10-Sep-07	6	0.01	0.01	0.01	0.01	0.01	2.6	
17-Sep-07	3	0.01	0.01	0.01	0.01	0.01	2.8	

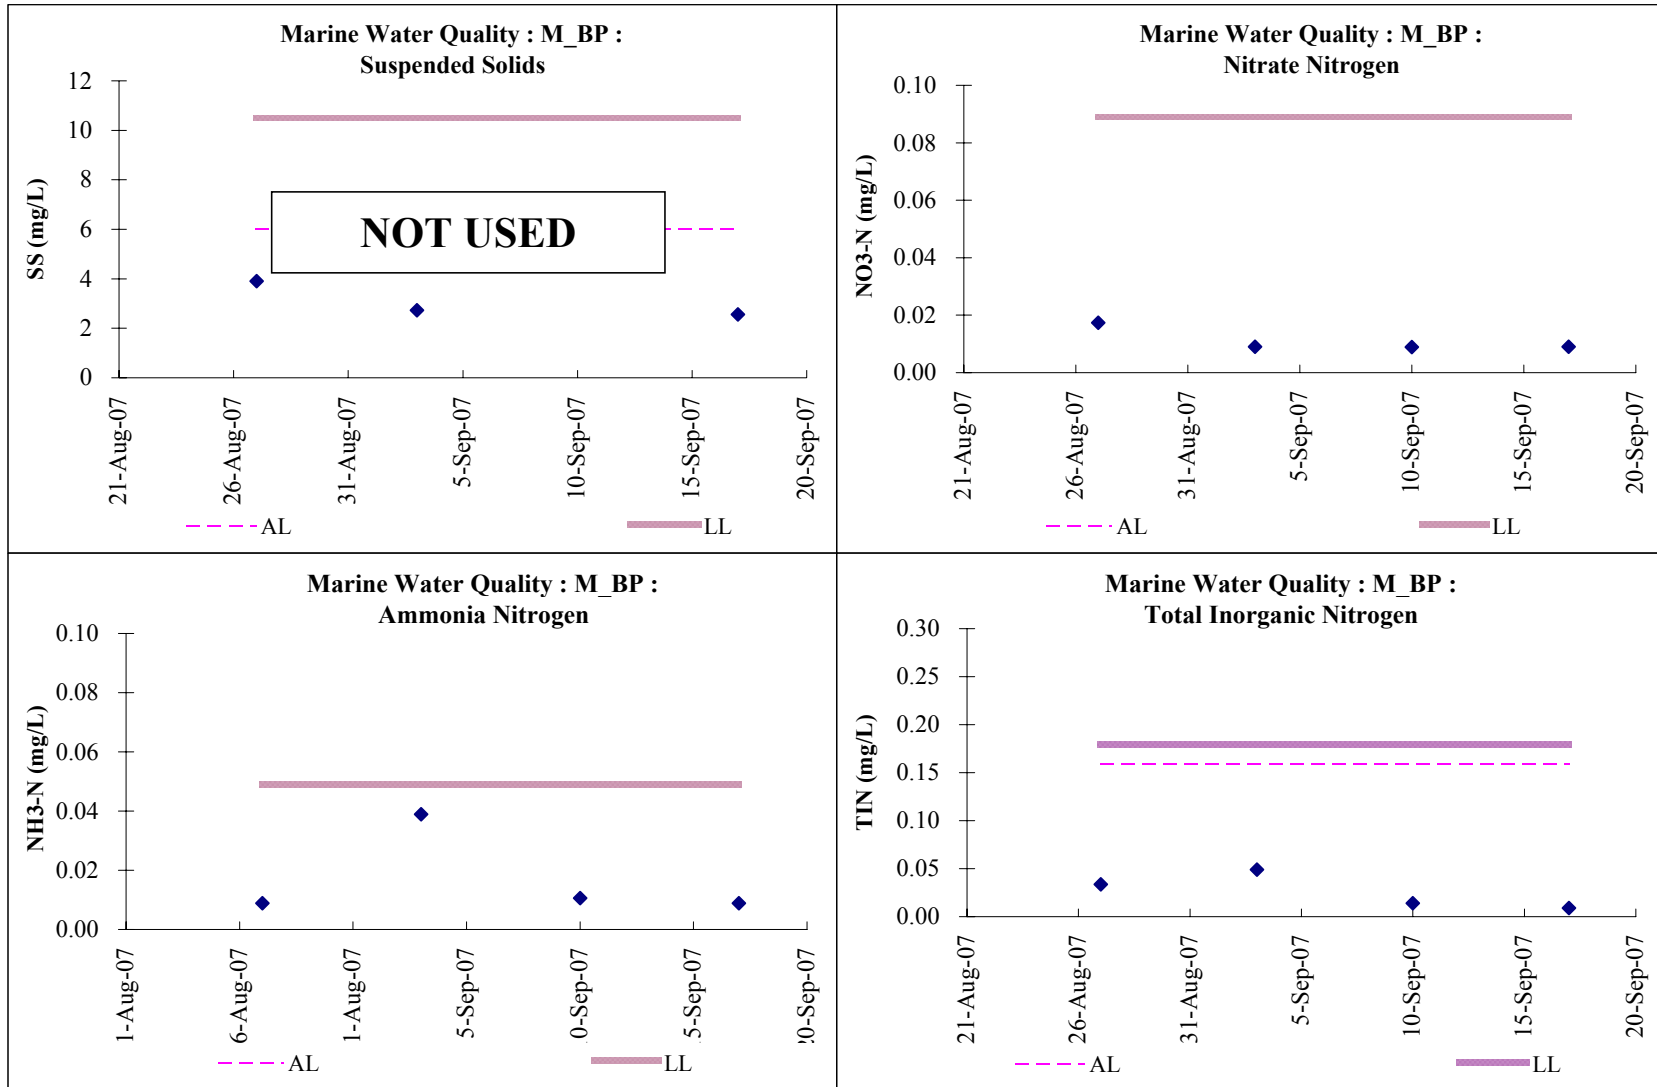

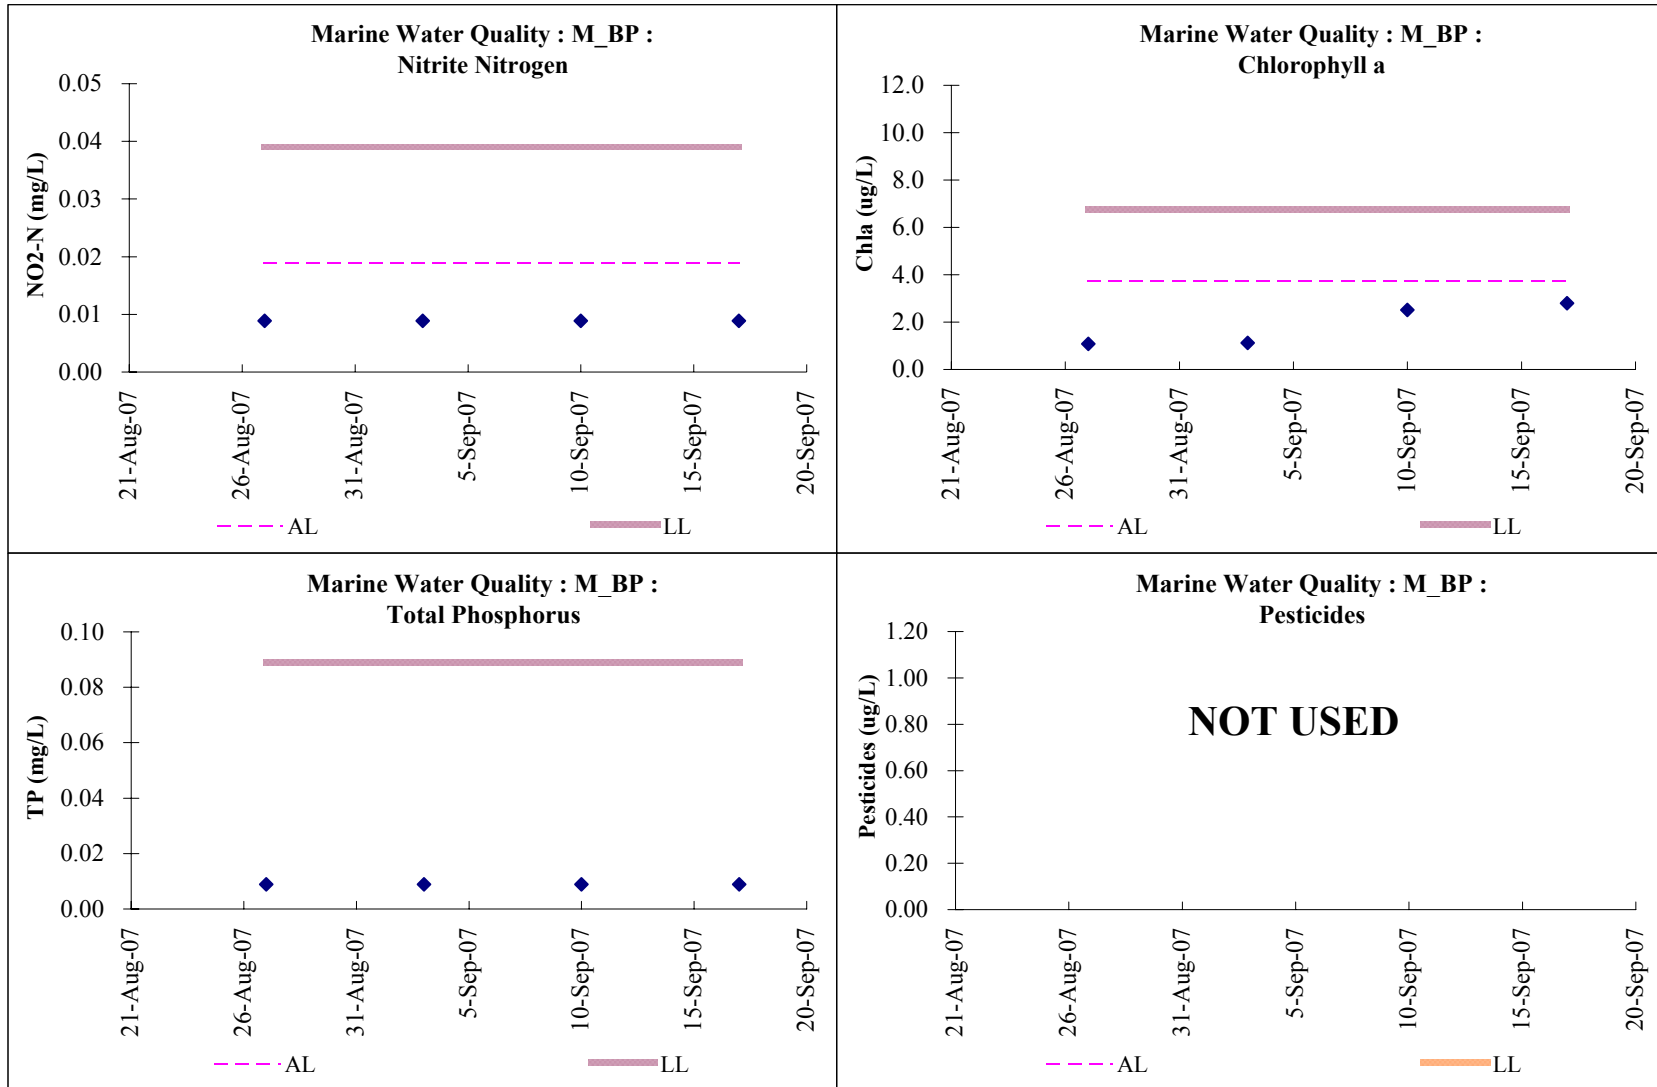

M_Coral		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:12	5	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	03-Sep-07	13:12	3	0.01	0.01	0.01	0.01	0.01	1.2	
Mid-Ebb	10-Sep-07	16:12	2	0.01	0.01	0.01	0.01	0.01	1.8	
Mid-Ebb	17-Sep-07	09:42	2	0.01	0.01	0.01	0.01	0.01	1.3	

M_Coral		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	10:42	7	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	03-Sep-07	12:12	3	0.04	0.01	0.01	0.06	0.01	1.2	
Mid-Flood	10-Sep-07	11:42	6	0.01	0.01	0.01	0.01	0.01	1.9	
Mid-Flood	17-Sep-07	16:12	5	0.01	0.01	0.01	0.01	0.01	1.3	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M_Coral										
Middle										
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:11	6	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	03-Sep-07	13:11	4	0.02	0.01	0.01	0.04	0.01	1.2	
Mid-Ebb	10-Sep-07	16:11	3	0.01	0.01	0.01	0.01	0.01	1.9	
Mid-Ebb	17-Sep-07	09:41	3	0.01	0.01	0.01	0.01	0.01	1.4	


M_Coral										
Middle										
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	10:41	4	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	03-Sep-07	12:11	2	0.11	0.01	0.01	0.13	0.01	1.2	
Mid-Flood	10-Sep-07	11:41	6	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	17-Sep-07	16:11	6	0.01	0.01	0.01	0.01	0.01	1.4	

M_Coral		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:10	4	0.18	0.01	0.01	0.20	0.01	1.7	
Mid-Ebb	03-Sep-07	13:10	3	0.01	0.01	0.01	0.01	0.01	1.2	
Mid-Ebb	10-Sep-07	16:10	2	0.01	0.01	0.01	0.01	0.01	1.8	
Mid-Ebb	17-Sep-07	09:40	2	0.03	0.02	0.01	0.06	0.01	1.4	

M_Coral		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	10:40	7	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	03-Sep-07	12:10	3	0.06	0.01	0.01	0.08	0.01	1.1	
Mid-Flood	10-Sep-07	11:40	6	0.01	0.01	0.01	0.01	0.01	1.9	
Mid-Flood	17-Sep-07	16:10	4	0.05	0.01	0.01	0.07	0.01	1.4	

M_Coral	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	6	0.04	0.01	0.01	0.04	0.01	1.6	
03-Sep-07	3	0.04	0.01	0.01	0.05	0.01	1.2	
10-Sep-07	4	0.01	0.01	0.01	0.01	0.01	1.8	
17-Sep-07	4	0.02	0.01	0.01	0.03	0.01	1.4	

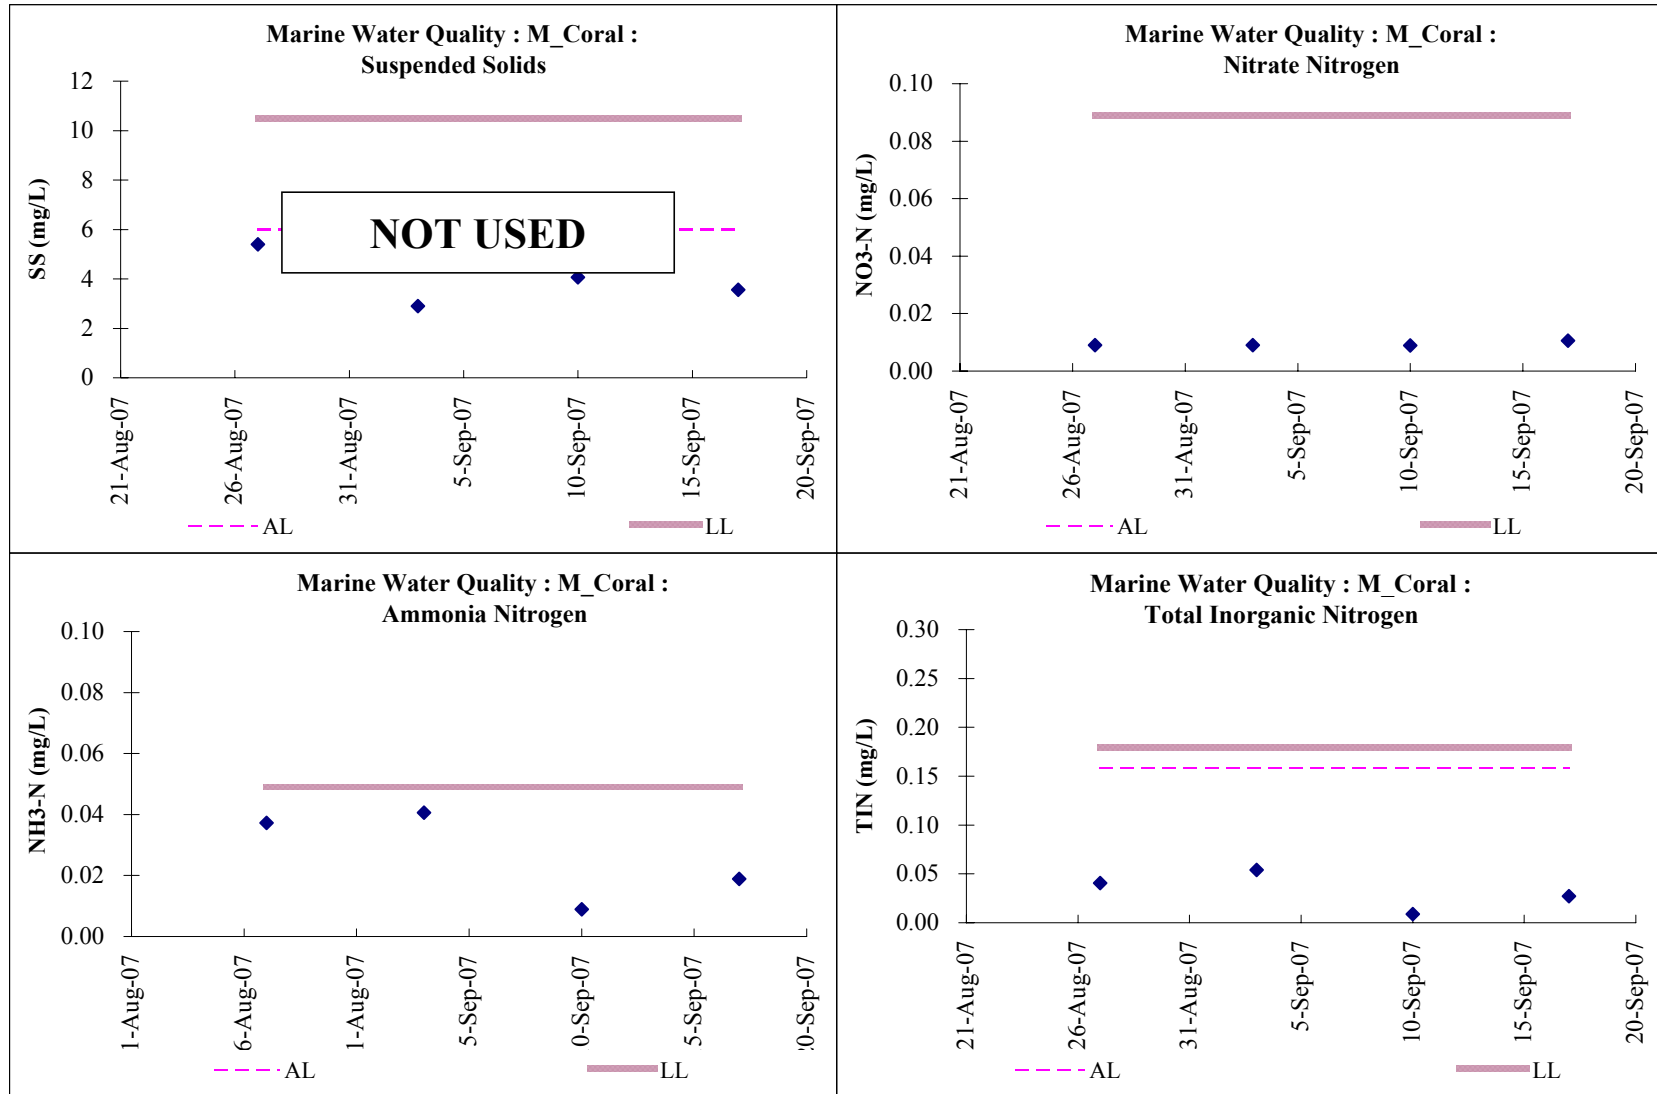

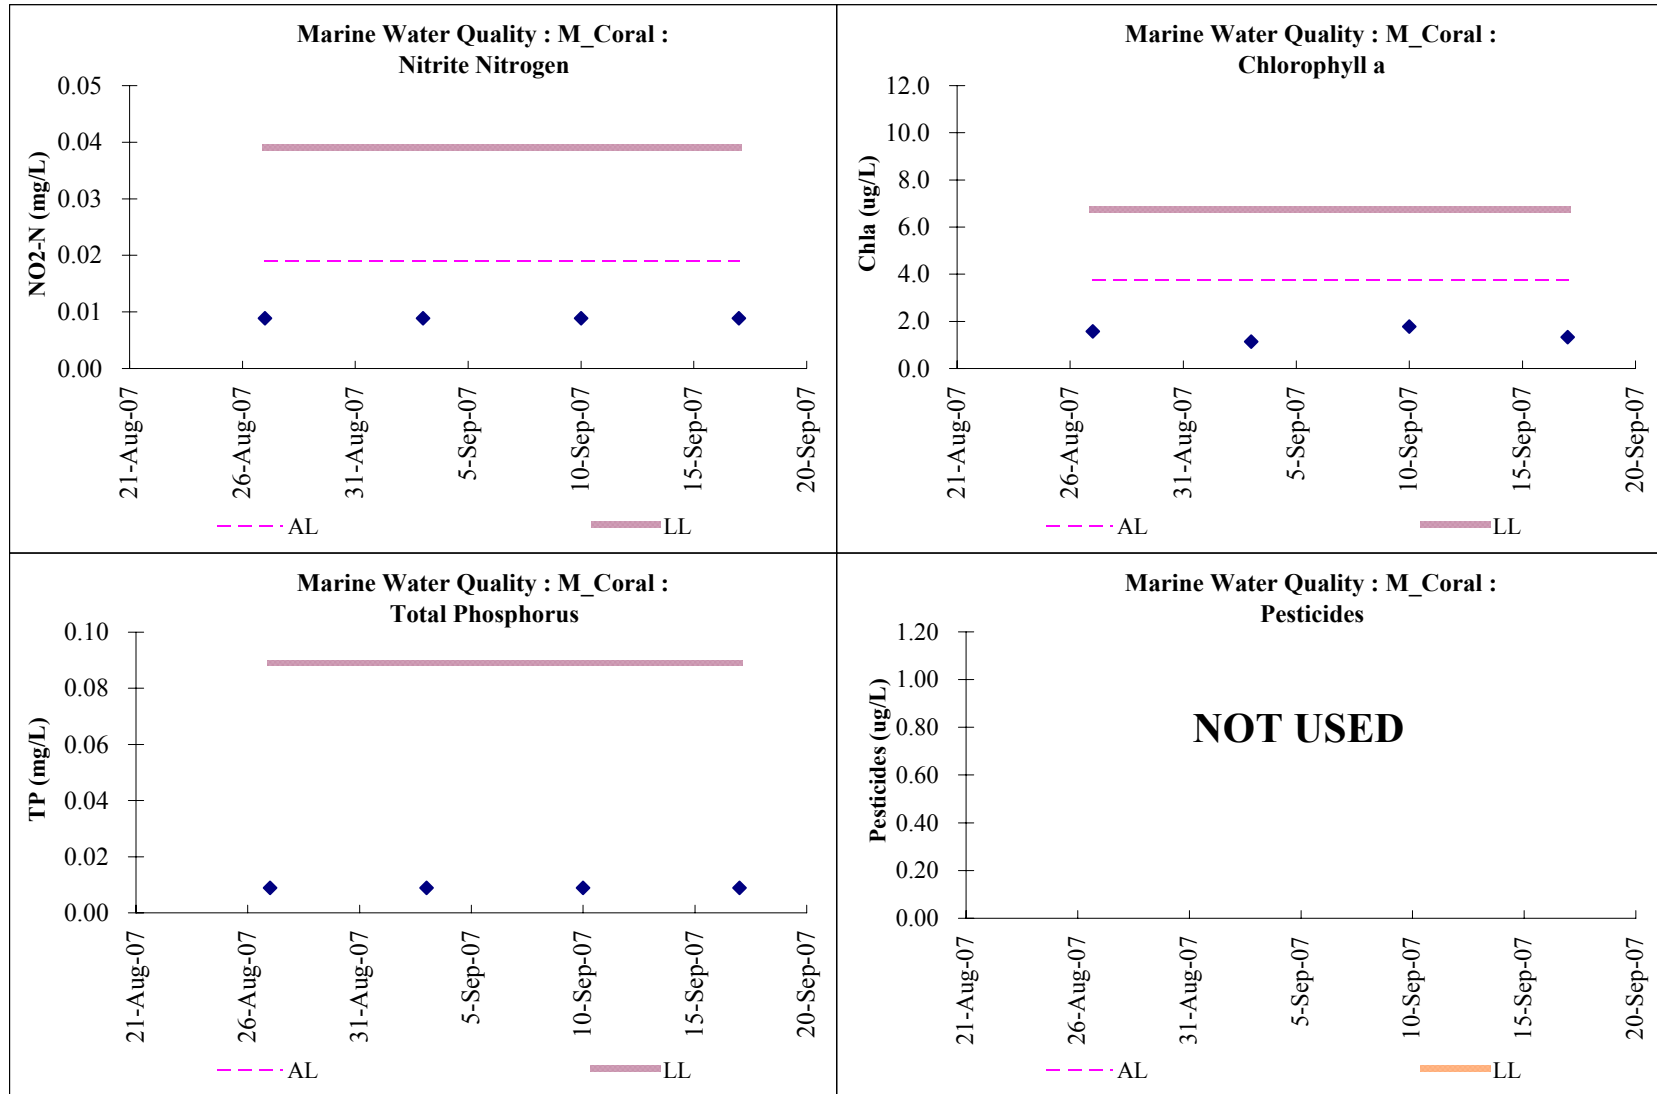

M B		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:22	2.0	0.01	0.01	0.01	0.01	0.01	1.7	
Mid-Ebb	03-Sep-07	13:22	2.0	0.01	0.01	0.01	0.01	0.01	1.2	
Mid-Ebb	10-Sep-07	16:22	6.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Ebb	17-Sep-07	09:52	2.0	0.01	0.01	0.01	0.01	0.01	1.4	

M B		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	10:52	3.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Flood	03-Sep-07	12:22	5.0	0.05	0.01	0.01	0.07	0.01	1.4	
Mid-Flood	10-Sep-07	11:52	3.0	0.06	0.01	0.01	0.08	0.01	1.5	
Mid-Flood	17-Sep-07	16:22	2.0	0.01	0.01	0.01	0.01	0.01	1.3	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


M B		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:21	4.0	0.17	0.01	0.01	0.19	0.01	1.9	
Mid-Ebb	03-Sep-07	13:21	2.0	0.01	0.01	0.01	0.01	0.01	1.2	
Mid-Ebb	10-Sep-07	16:21	3.0	0.02	0.01	0.01	0.04	0.01	1.9	
Mid-Ebb	17-Sep-07	09:51	2.0	0.01	0.01	0.01	0.01	0.01	1.3	


M B		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	10:51	3.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	03-Sep-07	12:21	4.0	0.08	0.01	0.01	0.10	0.01	1.3	
Mid-Flood	10-Sep-07	11:51	4.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	17-Sep-07	16:21	4.0	0.01	0.01	0.01	0.01	0.01	1.4	

M B		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:20	5.0	0.01	0.01	0.01	0.01	0.01	1.8	
Mid-Ebb	03-Sep-07	13:20	2.0	0.02	0.01	0.01	0.04	0.01	1.3	
Mid-Ebb	10-Sep-07	16:20	4.0	0.02	0.01	0.01	0.04	0.01	1.5	
Mid-Ebb	17-Sep-07	09:50	2.0	0.01	0.01	0.01	0.01	0.01	1.4	

M B		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	10:50	3.0	0.01	0.01	0.01	0.01	0.01	1.7	
Mid-Flood	03-Sep-07	12:20	4.0	0.02	0.01	0.01	0.04	0.01	1.2	
Mid-Flood	10-Sep-07	11:50	3.0	0.01	0.01	0.01	0.01	0.01	2.0	
Mid-Flood	17-Sep-07	16:20	3.0	0.01	0.01	0.01	0.01	0.01	1.2	

M_B	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	3	0.04	0.01	0.01	0.04	0.01	1.7	
03-Sep-07	3	0.03	0.01	0.01	0.04	0.01	1.3	
10-Sep-07	4	0.02	0.01	0.01	0.03	0.01	1.7	
17-Sep-07	2	0.01	0.01	0.01	0.01	0.01	1.3	

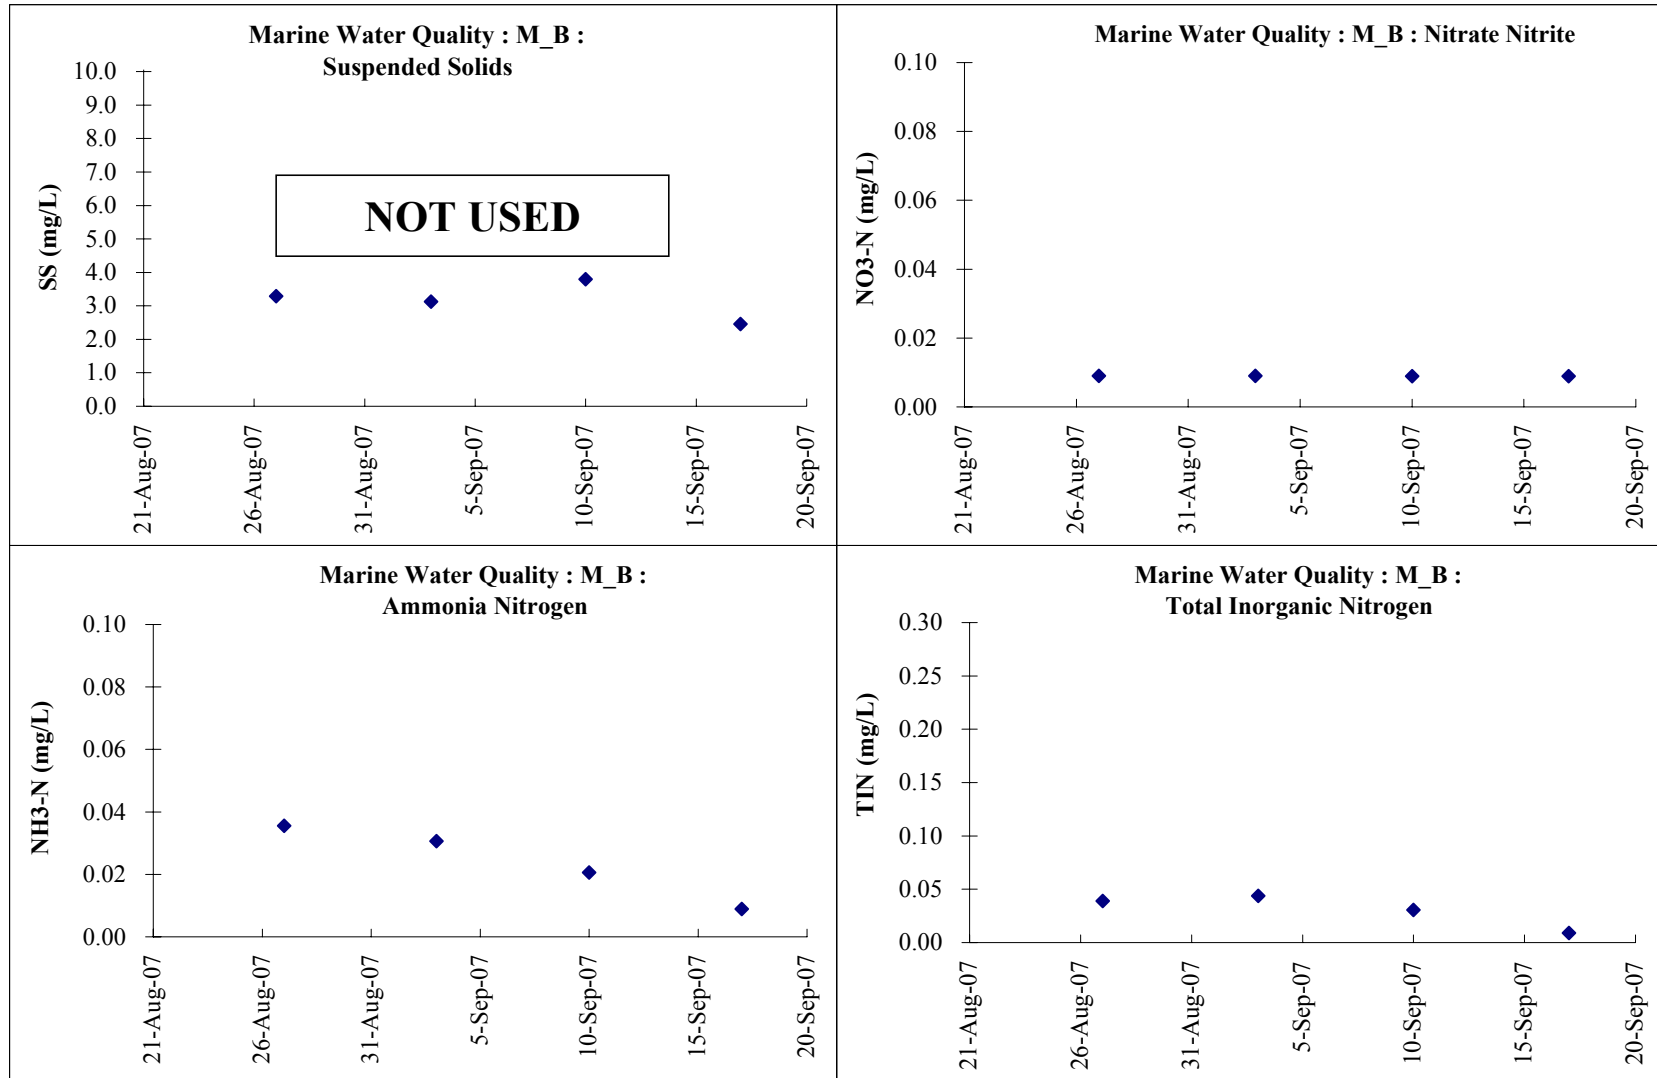

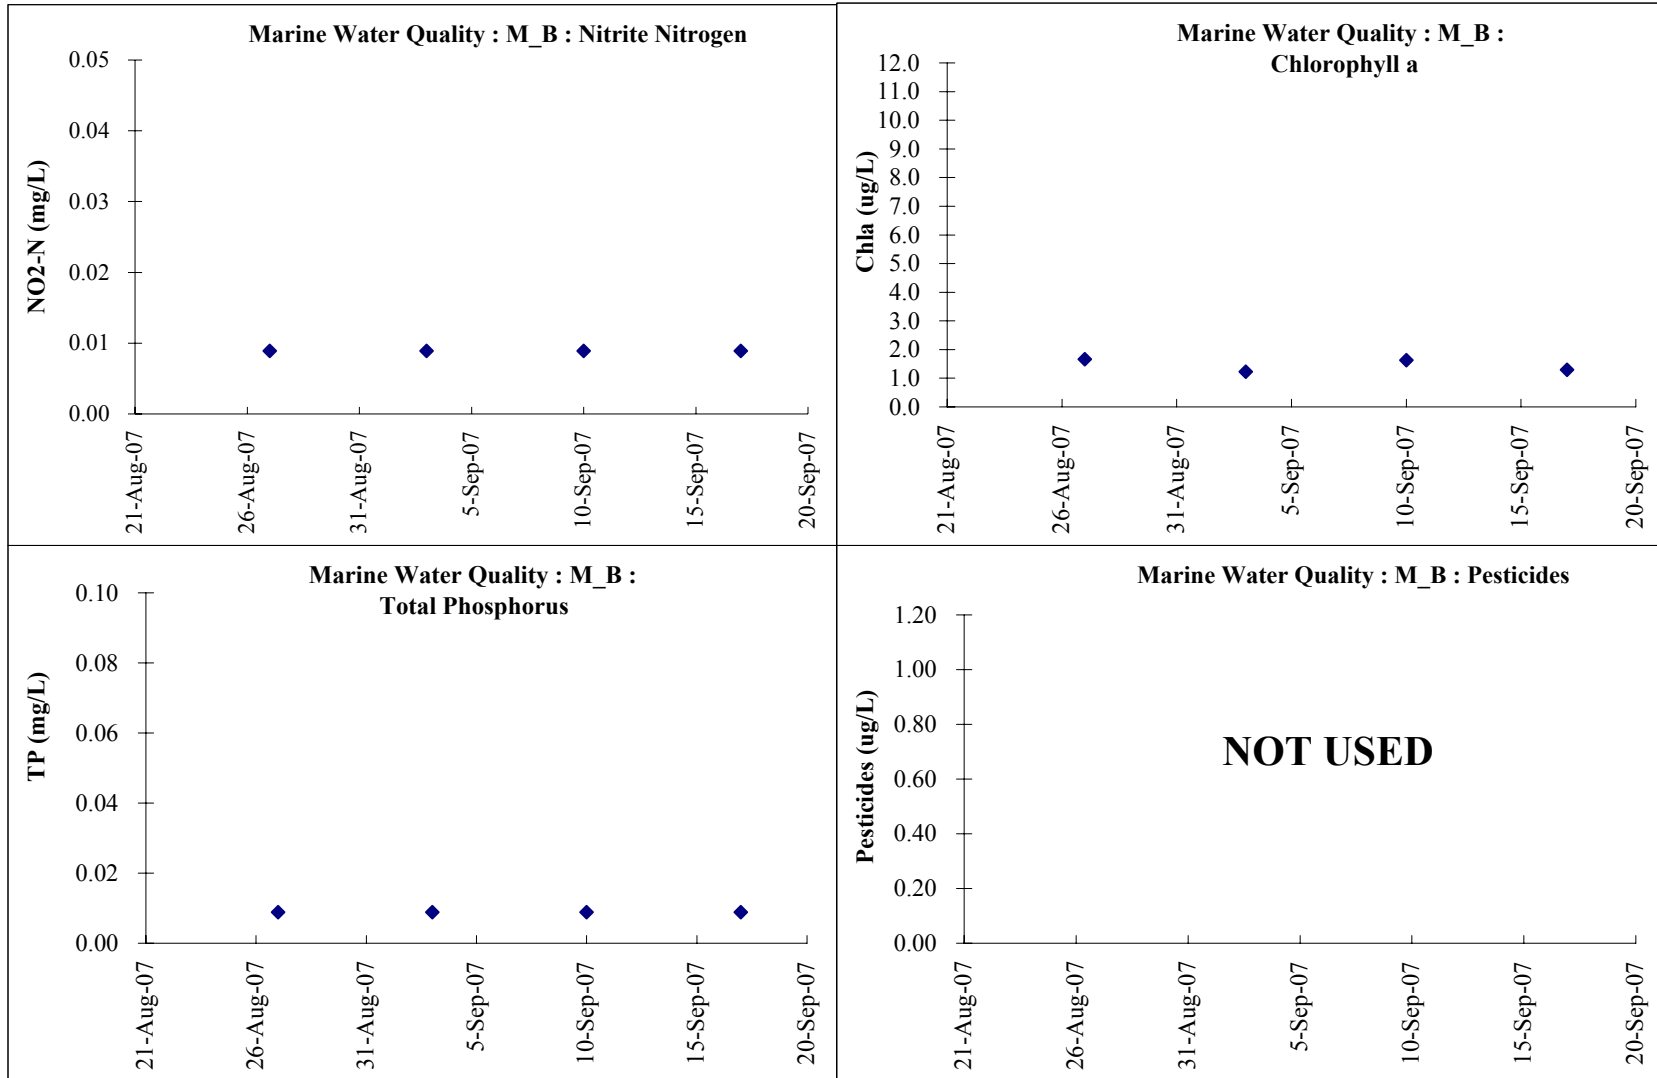

KS		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:52	5.0	0.04	0.01	0.01	0.06	0.01	1.7	
Mid-Ebb	03-Sep-07	13:52	2.0	0.11	0.02	0.01	0.14	0.01	1.3	
Mid-Ebb	10-Sep-07	16:52	8.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	17-Sep-07	10:22	2.0	0.01	0.01	0.01	0.01	0.01	1.3	

KS		Surface								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	11:22	3.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Flood	03-Sep-07	12:52	2.0	0.04	0.01	0.01	0.06	0.01	1.2	
Mid-Flood	10-Sep-07	12:22	2.0	0.01	0.01	0.01	0.01	0.01	2.1	
Mid-Flood	17-Sep-07	16:52	2.0	0.01	0.01	0.01	0.01	0.01	1.4	

Remarks:

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey


KS		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:51	2.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	03-Sep-07	13:51	2.0	0.01	0.02	0.01	0.04	0.01	1.3	
Mid-Ebb	10-Sep-07	16:51	10.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Ebb	17-Sep-07	10:21	2.0	0.01	0.01	0.01	0.01	0.01	1.5	


KS		Middle								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	11:21	4.0	0.01	0.01	0.01	0.01	0.01	1.7	
Mid-Flood	03-Sep-07	12:51	3.0	0.01	0.01	0.01	0.01	0.01	1.3	
Mid-Flood	10-Sep-07	12:21	2.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Flood	17-Sep-07	16:51	2.0	0.01	0.01	0.01	0.01	0.01	1.3	

KS		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Ebb	27-Aug-07	16:50	3.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Ebb	03-Sep-07	13:50	2.0	0.04	0.01	0.01	0.06	0.01	1.3	
Mid-Ebb	10-Sep-07	16:50	6.0	0.01	0.01	0.01	0.01	0.01	1.5	
Mid-Ebb	17-Sep-07	10:20	2.0	0.01	0.01	0.01	0.01	0.01	1.3	

KS		Bottom								
tide condition	Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
Mid-Flood	27-Aug-07	11:20	3.0	0.01	0.01	0.01	0.01	0.01	1.6	
Mid-Flood	03-Sep-07	12:50	3.0	0.01	0.01	0.01	0.01	0.01	1.4	
Mid-Flood	10-Sep-07	12:20	2.0	0.01	0.01	0.01	0.01	0.01	1.8	
Mid-Flood	17-Sep-07	16:50	2.0	0.01	0.01	0.01	0.01	0.01	1.3	

KS	Depth-averaged							
	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	3	0.01	0.01	0.01	0.02	0.01	1.6	
03-Sep-07	2	0.04	0.01	0.01	0.05	0.01	1.3	
10-Sep-07	5	0.01	0.01	0.01	0.01	0.01	1.7	
17-Sep-07	2	0.01	0.01	0.01	0.01	0.01	1.4	

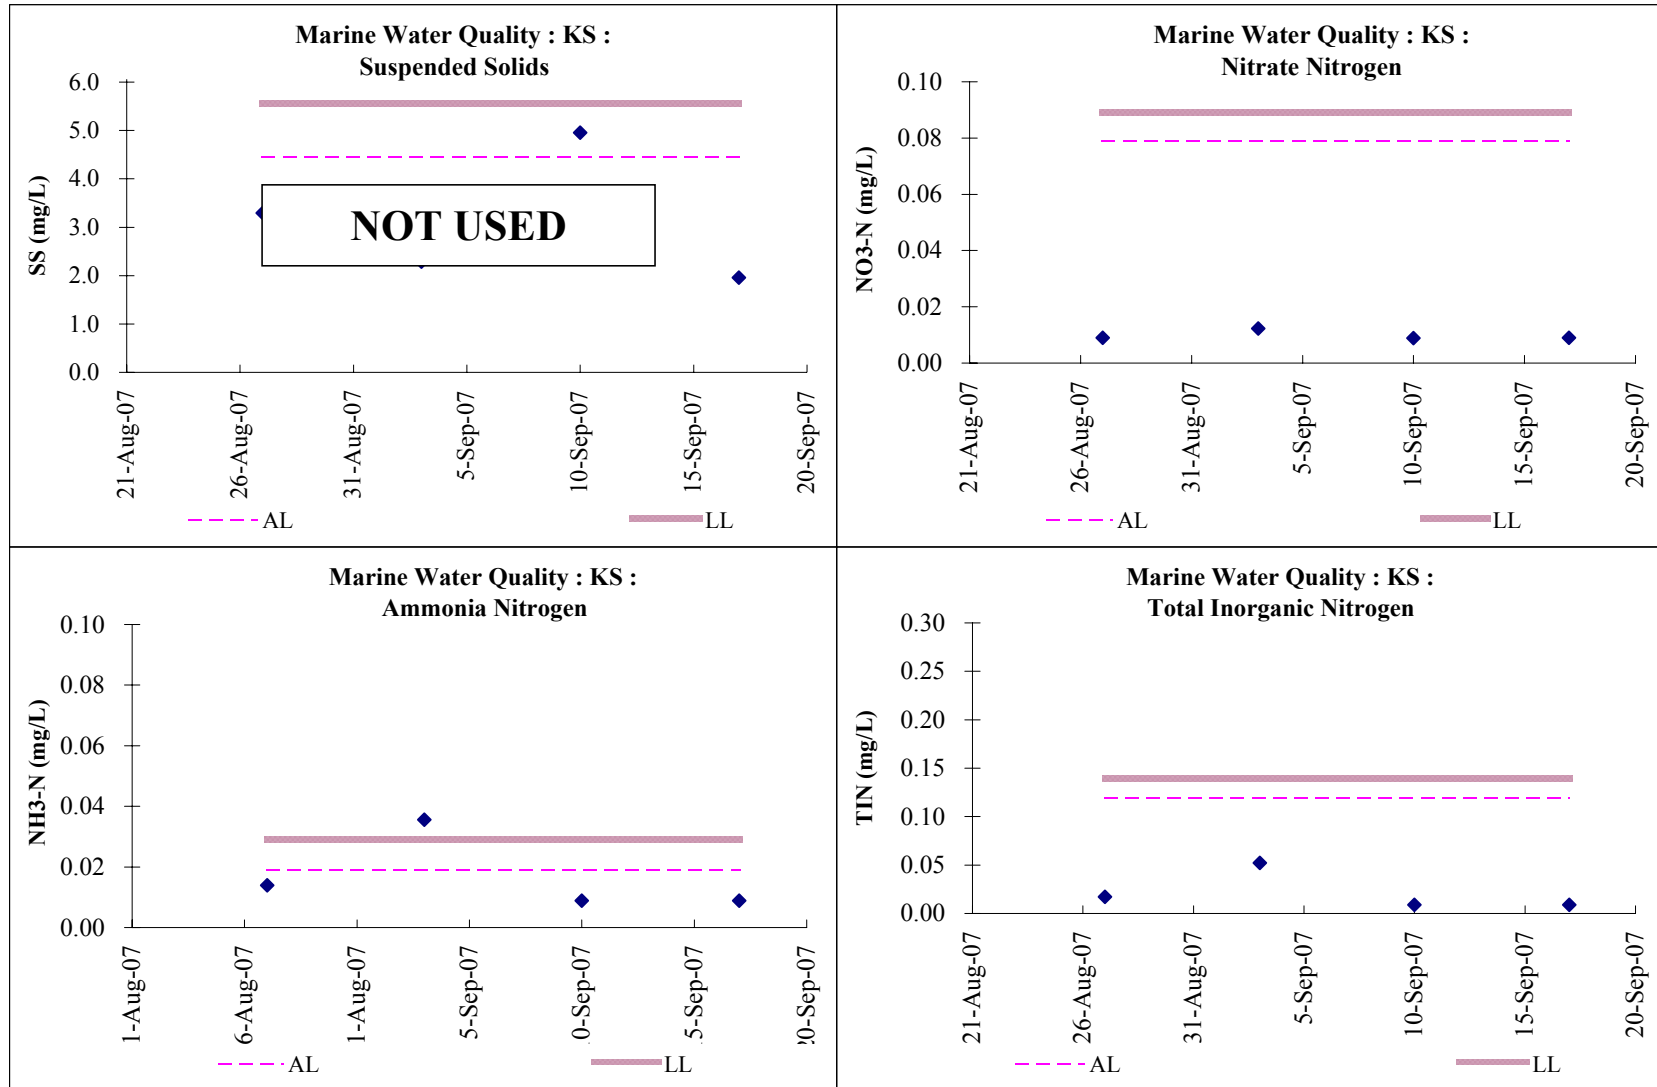


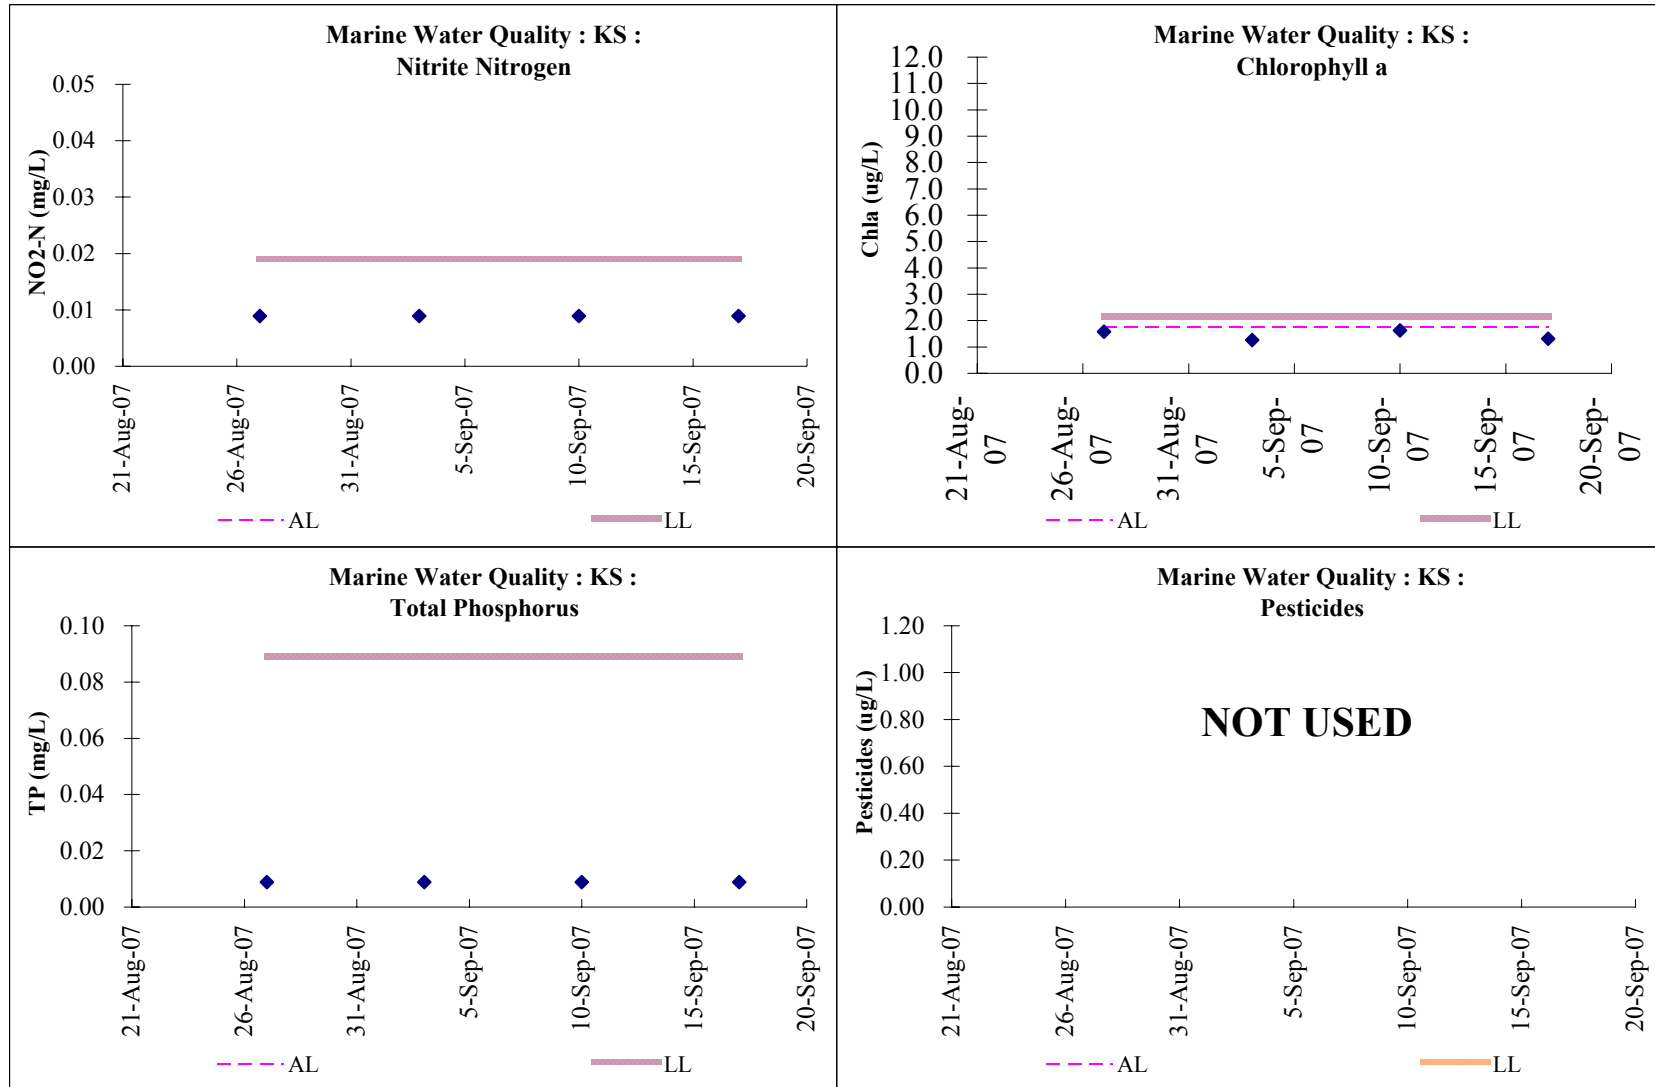


F UA		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	09:25	2	-	-	-	-	-	-	-
03-Sep-07	10:55	2	0.01	0.10	0.01	0.12	0.01	0.9	
10-Sep-07	10:25	2	0.01	0.10	0.01	0.12	0.01	0.5	
17-Sep-07	14:55	2	0.01	0.09	0.01	0.11	0.01	0.5	

F DA		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	09:35	2	-	-	-	-	-	-	-
03-Sep-07	11:05	3	0.14	0.10	0.01	0.25	0.01	0.9	
10-Sep-07	10:35	2	0.01	0.10	0.01	0.12	0.01	0.5	
17-Sep-07	15:05	2	0.02	0.09	0.01	0.12	0.01	0.5	

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

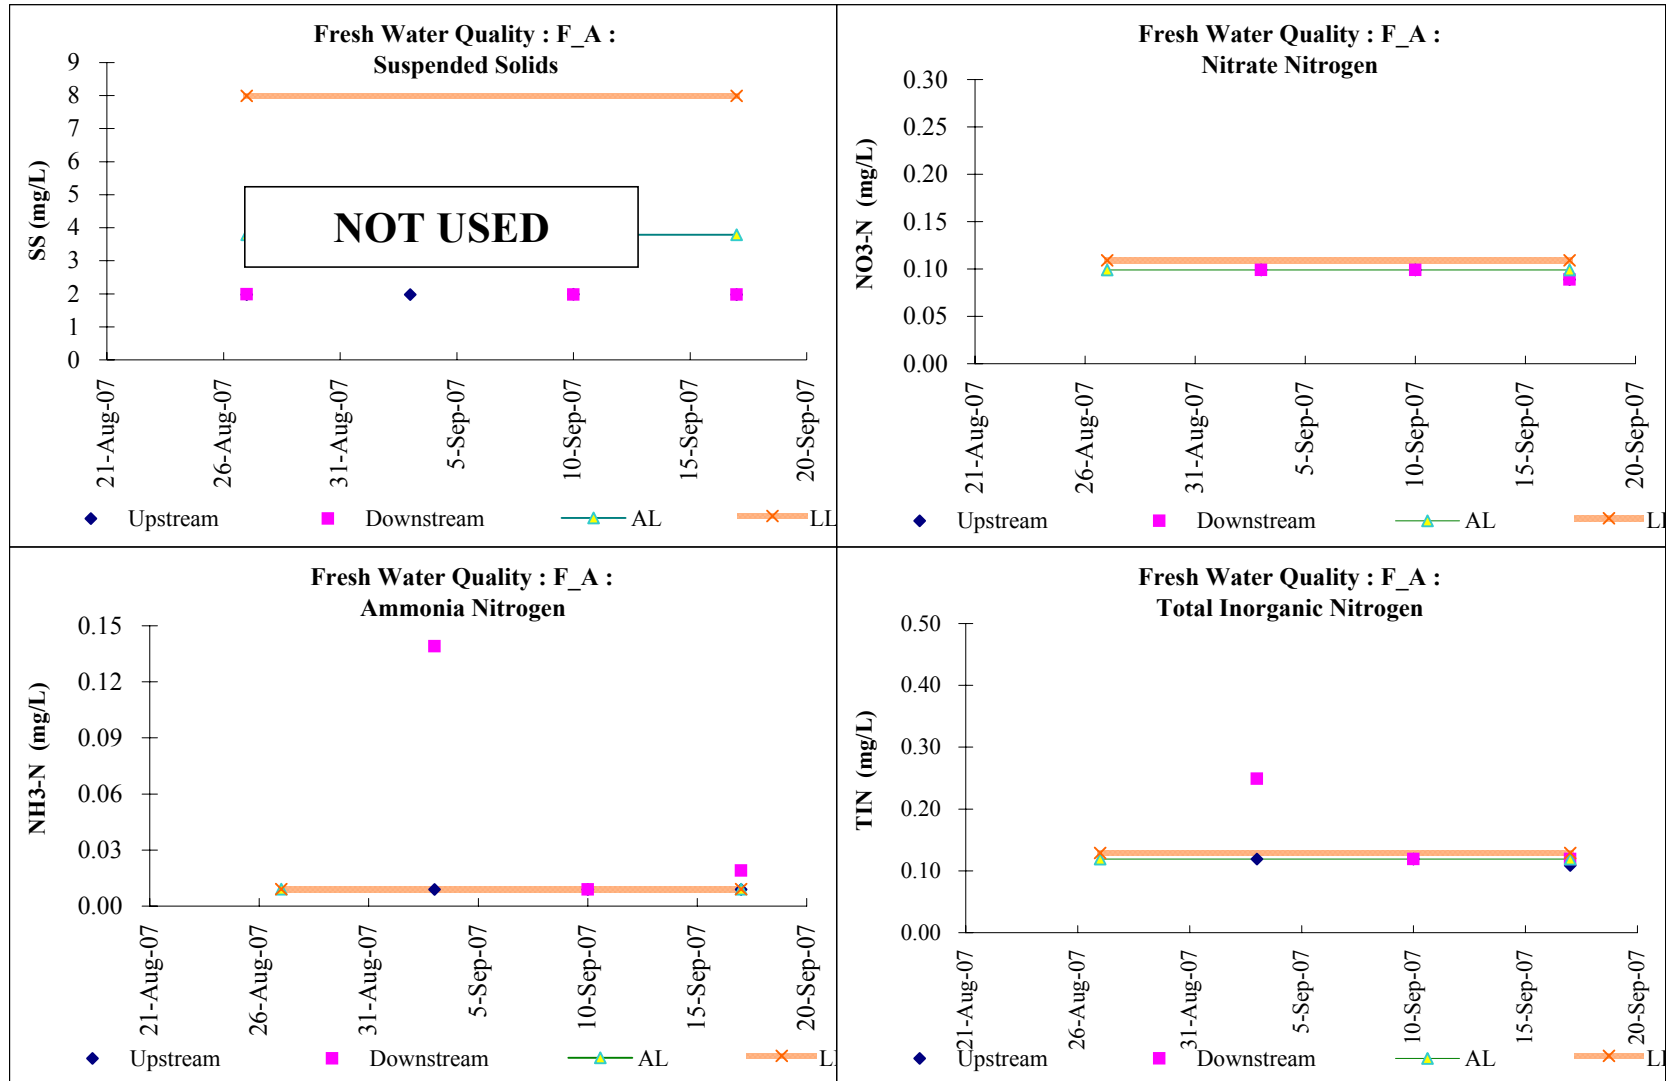


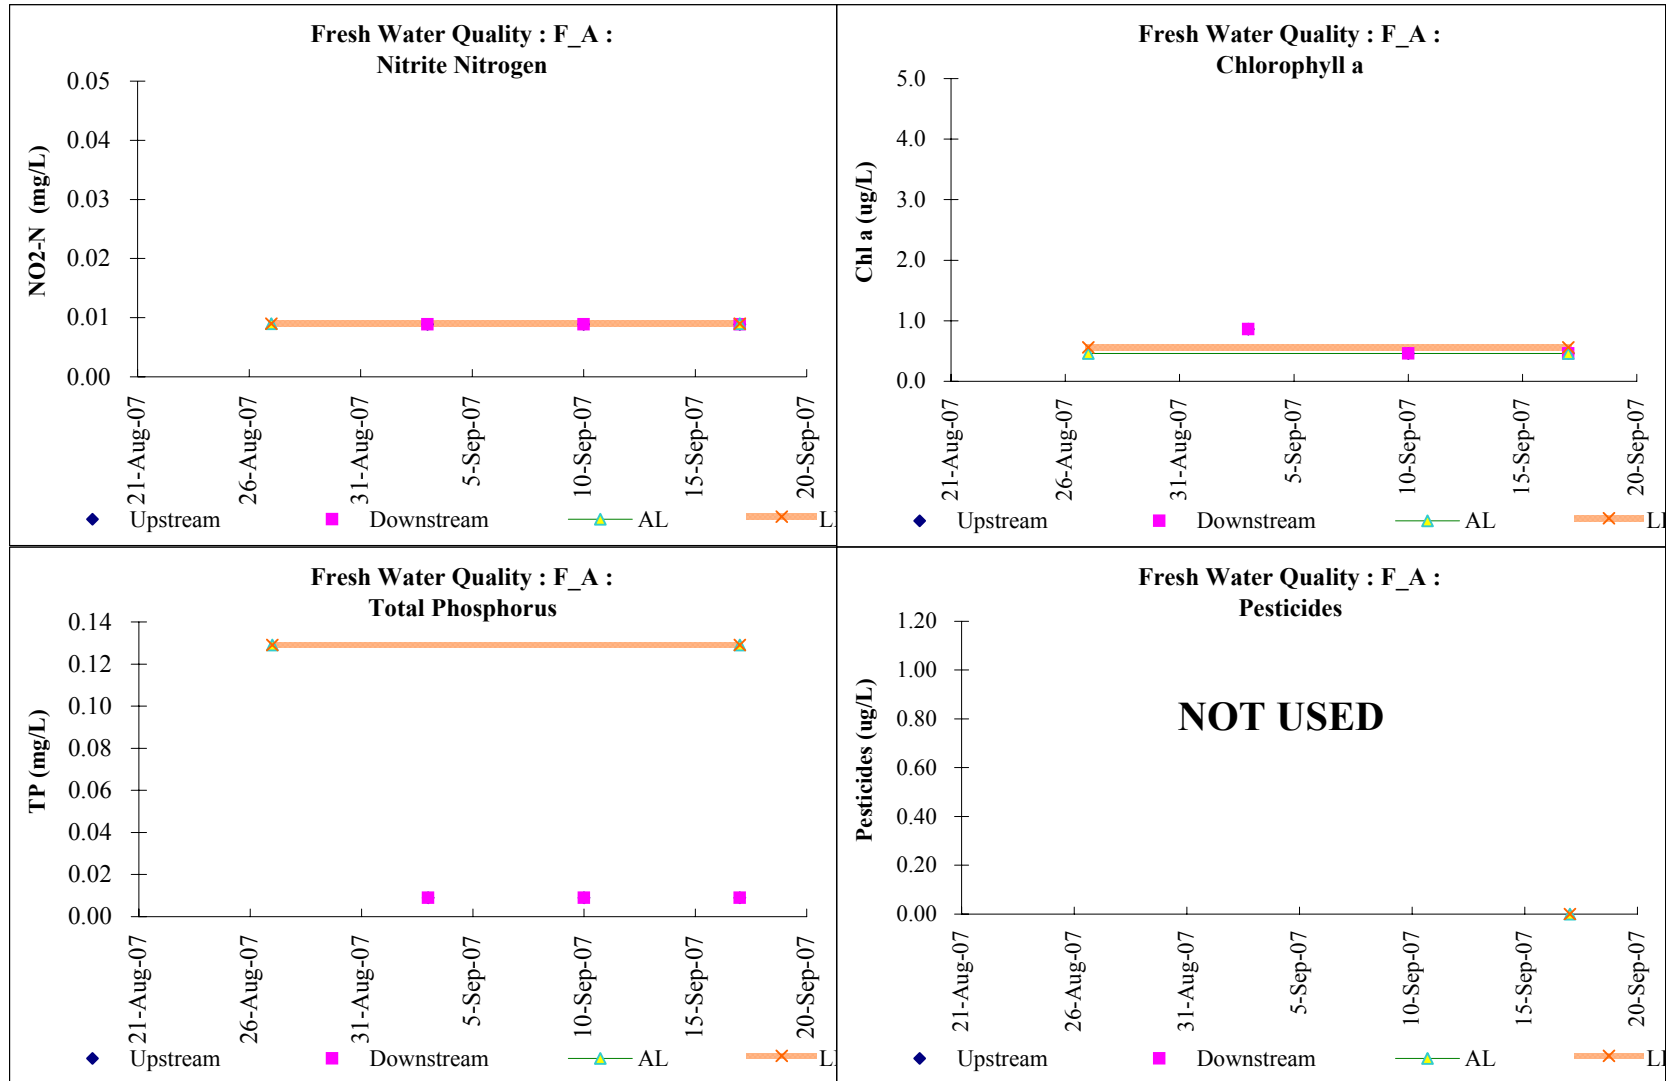


F UB		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	09:50	3	0.01	0.07	0.01	0.09	0.01	0.5	
03-Sep-07	11:20	5	0.01	0.06	0.01	0.08	0.01	0.6	
10-Sep-07	10:50	3	0.01	0.06	0.01	0.08	0.01	0.9	
17-Sep-07	15:20	4	0.01	0.09	0.01	0.11	0.01	0.5	

F DB		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	10:00	6	0.01	0.12	0.01	0.14	0.01	0.7	
03-Sep-07	11:30	5	0.03	0.14	0.01	0.18	0.01	1.3	
10-Sep-07	11:00	9	0.01	0.10	0.01	0.12	0.01	1.1	
17-Sep-07	15:30	6	0.01	0.11	0.01	0.13	0.01	0.8	

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

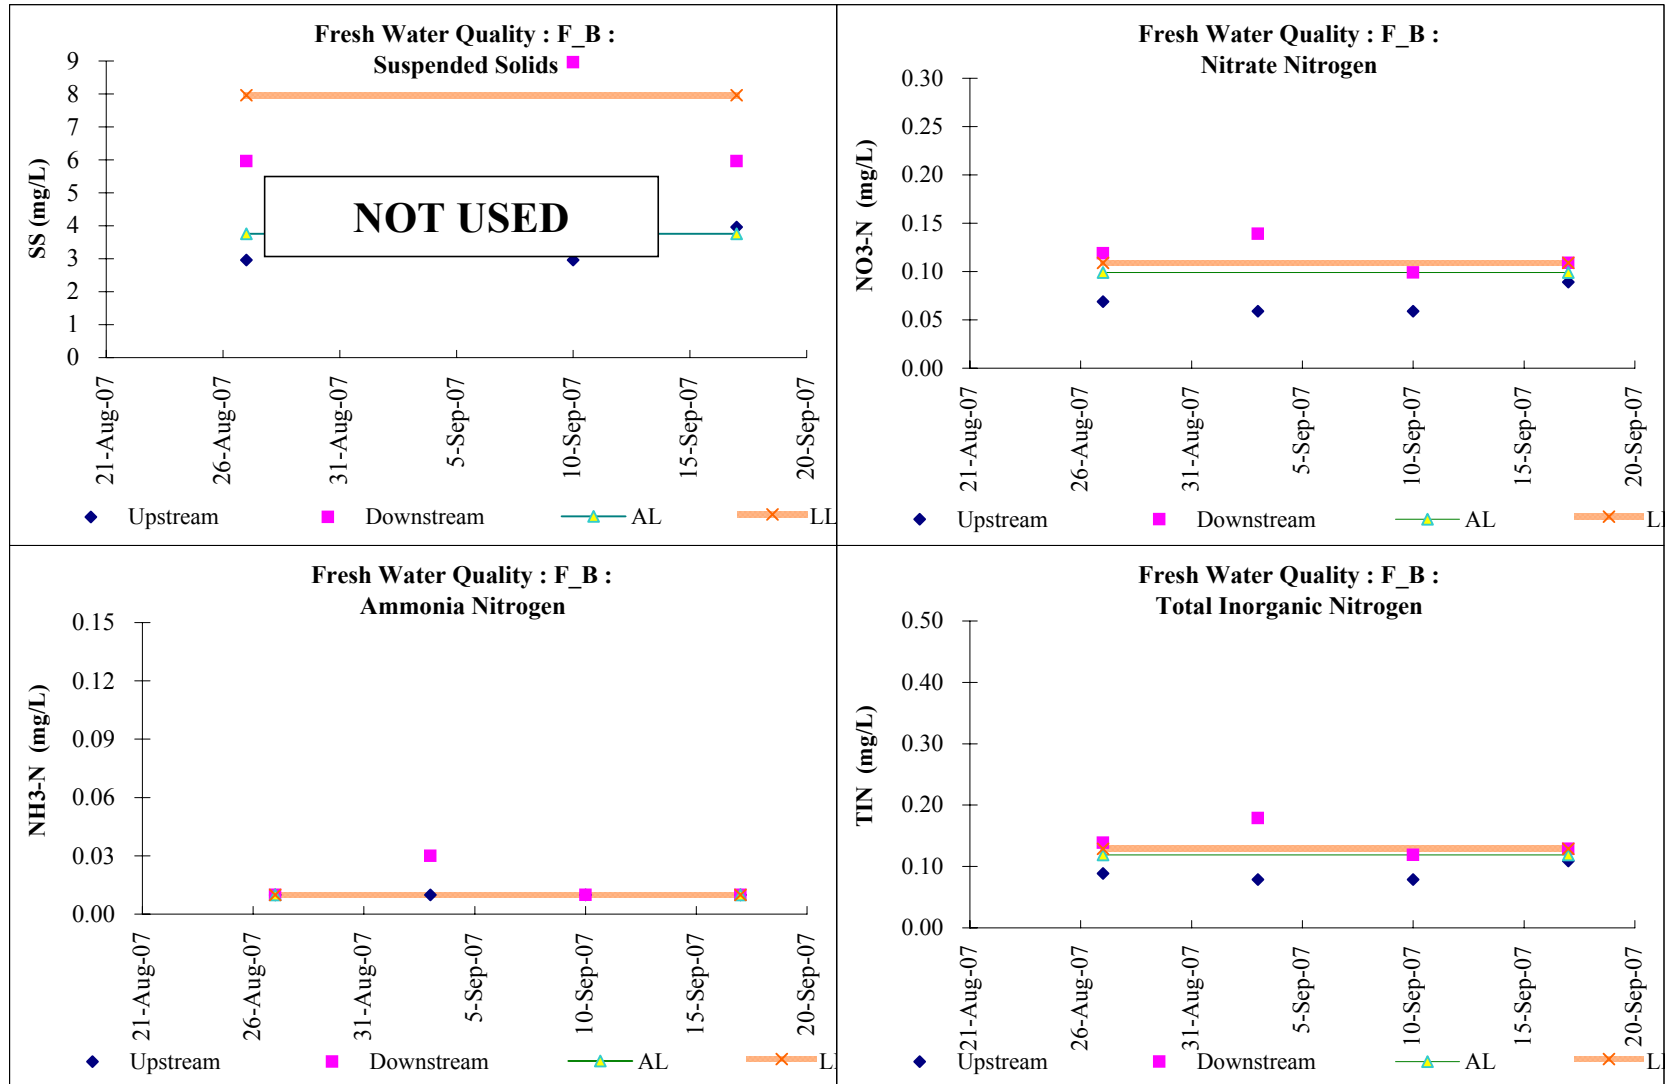


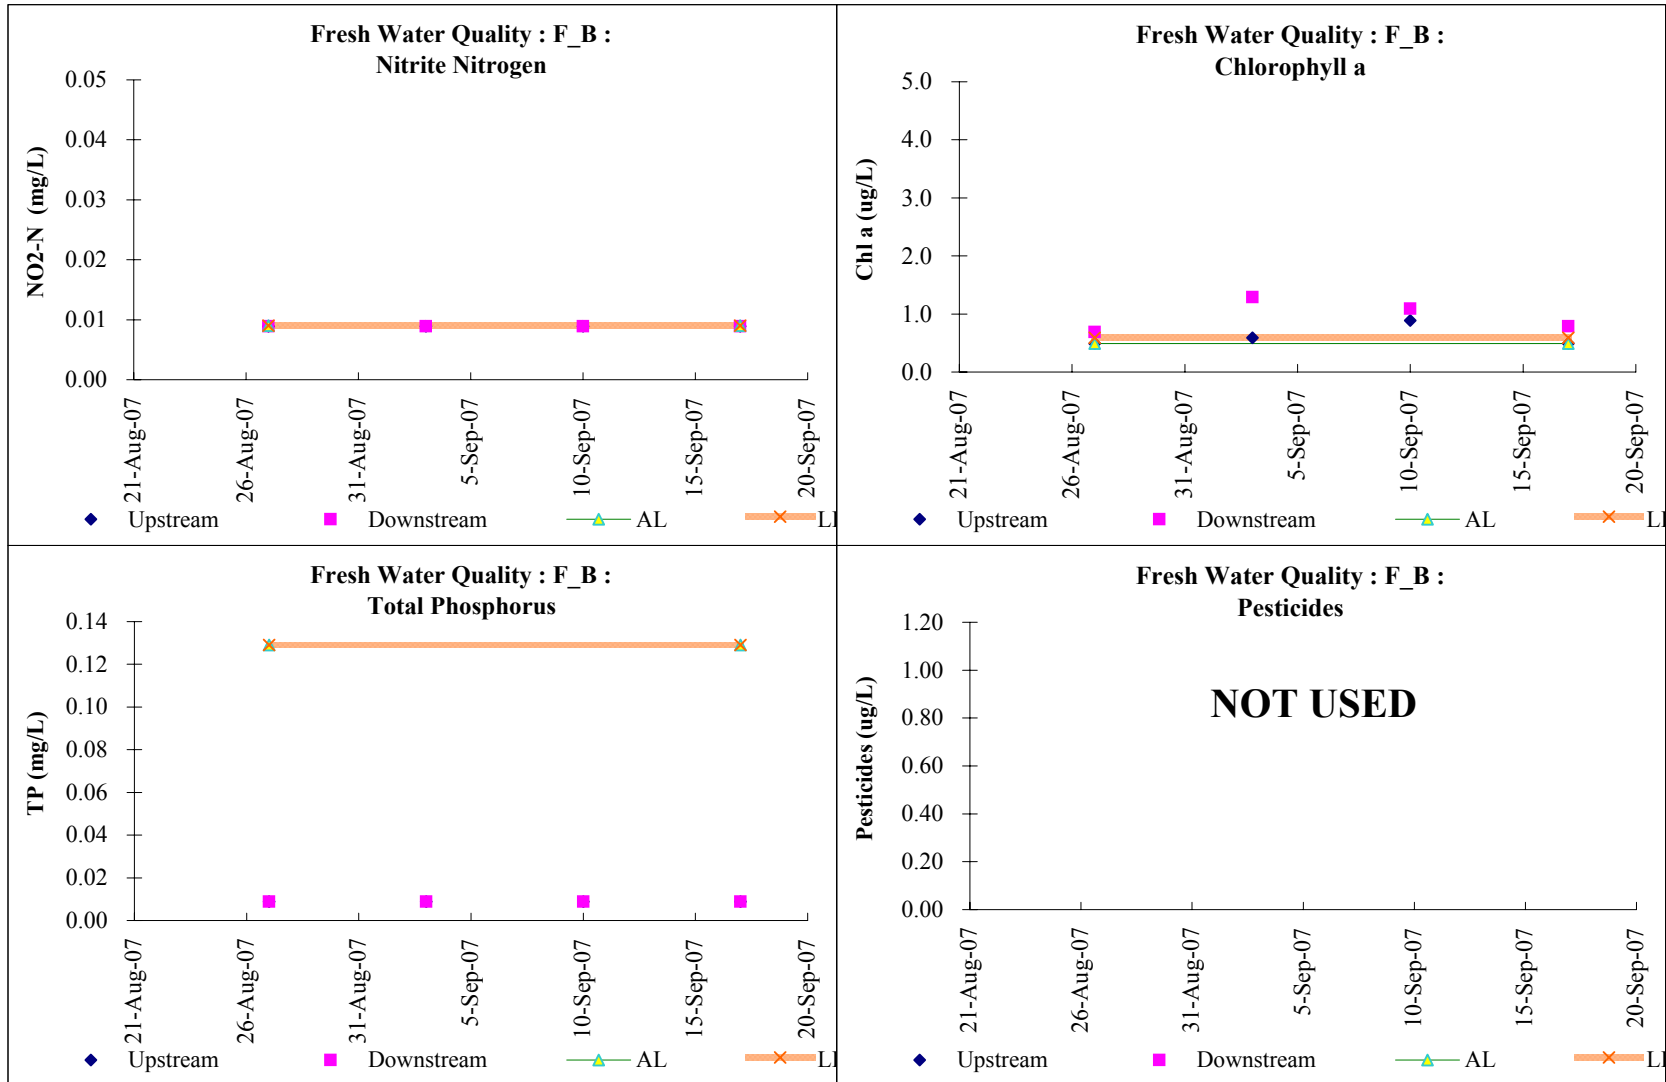


F UC		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	10:15	3	0.01	0.10	0.01	0.12	0.01	0.5	
03-Sep-07	11:45	2	0.05	0.09	0.01	0.15	0.01	0.5	
10-Sep-07	11:15	9	0.01	0.10	0.01	0.12	0.01	0.6	
17-Sep-07	15:45	7	0.01	0.15	0.01	0.17	0.01	2.9	

F DC		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	10:25	4	0.01	0.12	0.01	0.14	0.01	0.5	
03-Sep-07	11:55	6	0.01	0.19	0.01	0.21	0.01	0.5	
10-Sep-07	11:25	4	0.01	0.17	0.01	0.19	0.01	3.6	
17-Sep-07	15:55	2	0.01	0.29	0.01	0.31	0.01	1.9	

Action level	<i>Bold & Italic</i>
Limit level	Bold
< detection limit	Grey

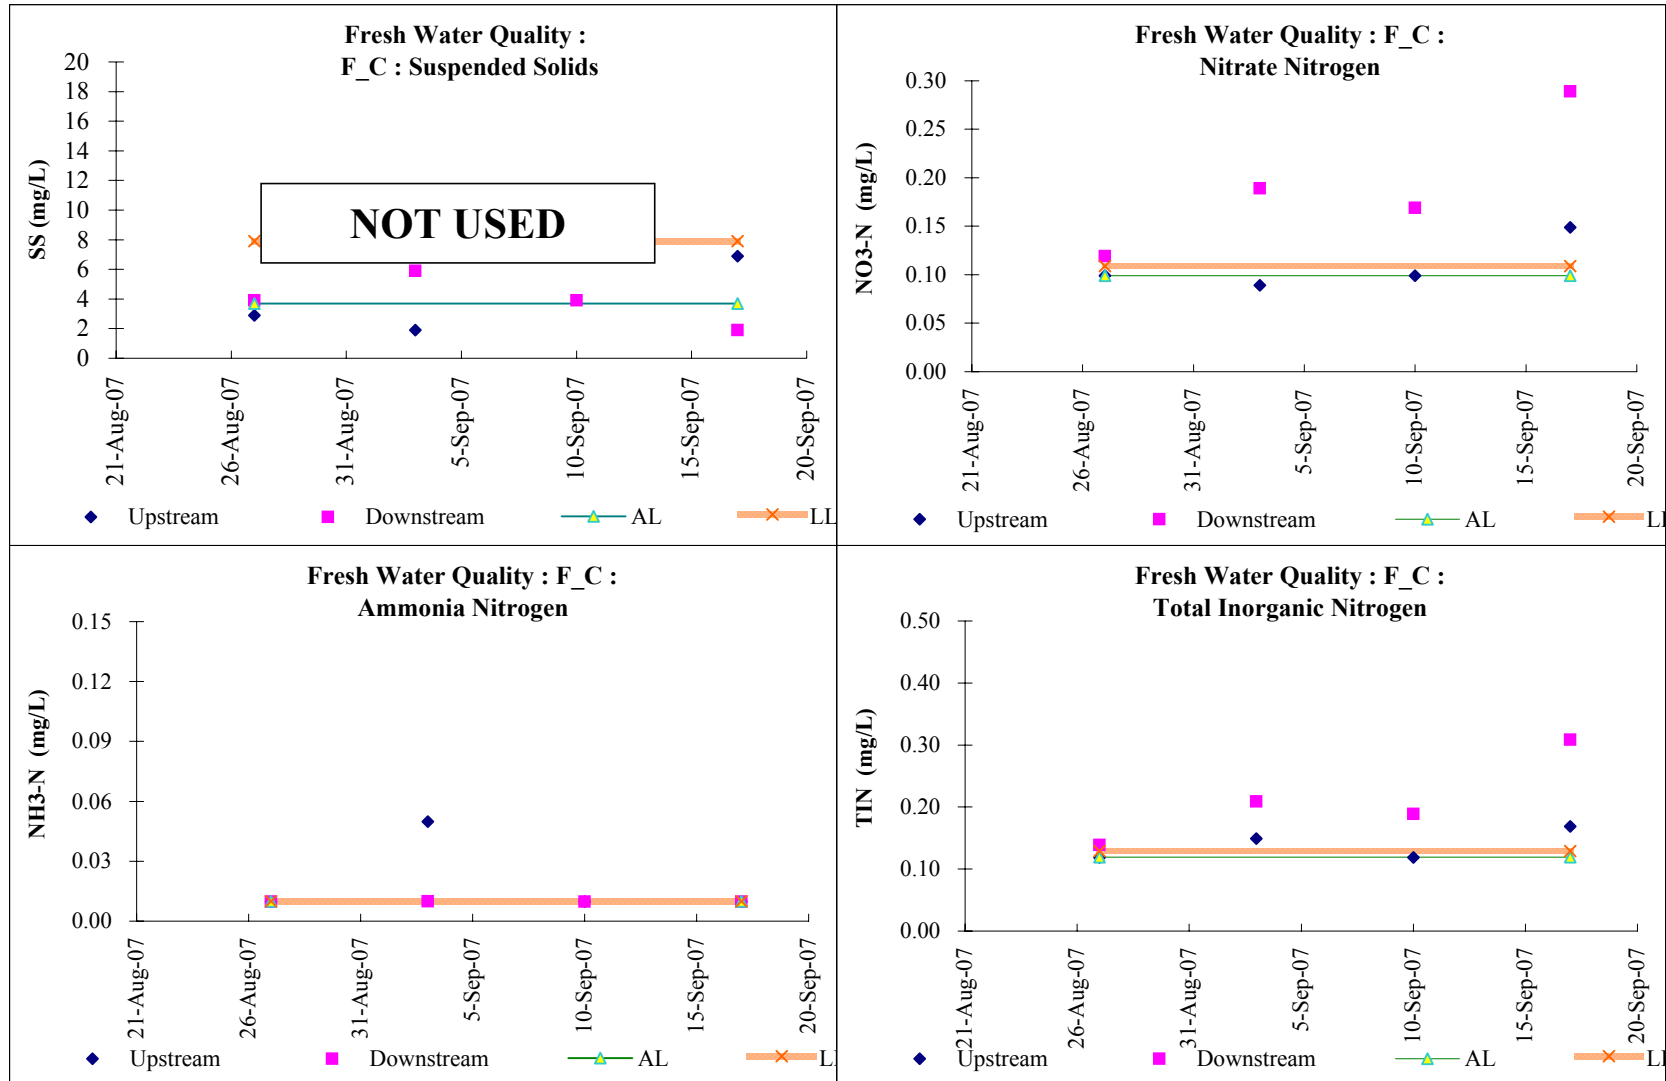

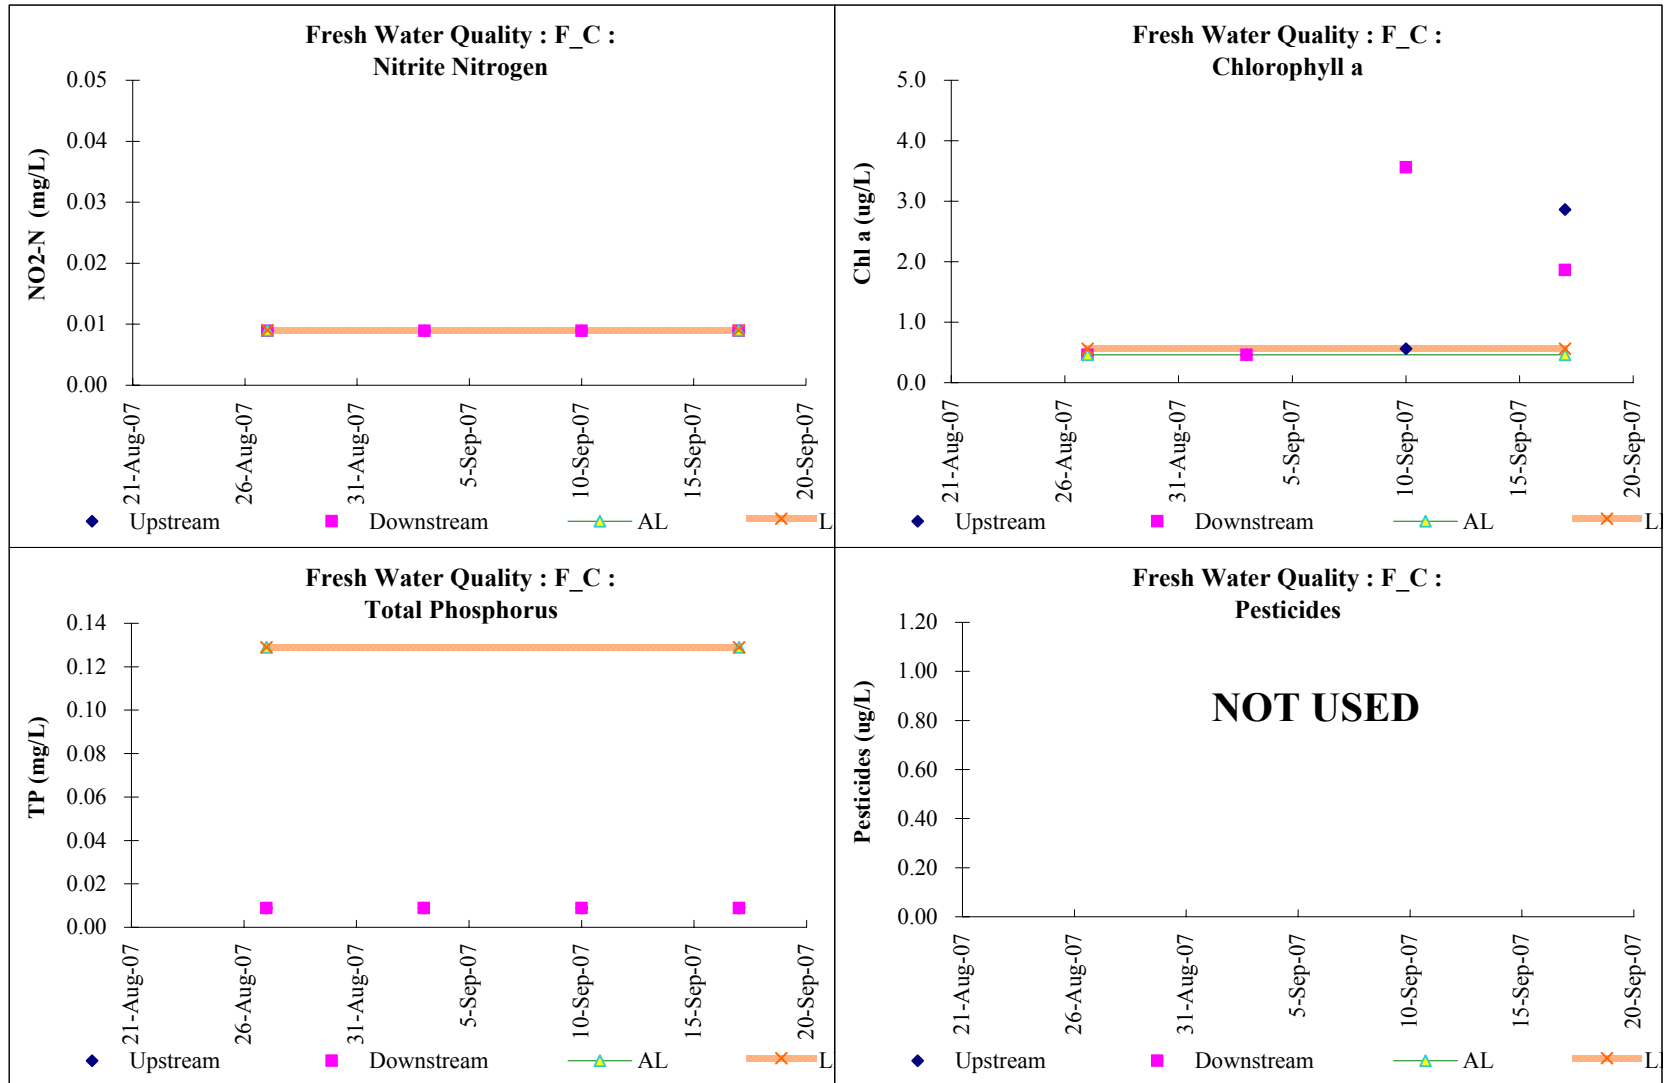



Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
Water Quality Monitoring Results

Nutrients

F Inland M		Mid depth							
Date	time	SS (mg/L)	NH ₃ -N (mg/L)	NO ₃ -N (mg/L)	NO ₂ -N (mg/L)	TIN (mg/L)	TP (mg/L)	Chlorophyll a (ug/L)	Pesticides (ug/L)
27-Aug-07	08:45	2	0.01	0.13	0.01	0.15	0.01	0.5	
03-Sep-07	10:15	2	0.01	0.15	0.01	0.17	0.01	1.0	
10-Sep-07	09:45	3	0.01	0.15	0.01	0.17	0.01	0.5	
17-Sep-07	14:15	2	0.04	0.10	0.01	0.15	0.01	0.5	

17-Sep-07	<i>Bold & Italic</i>
	Bold
< detection limit	Grey

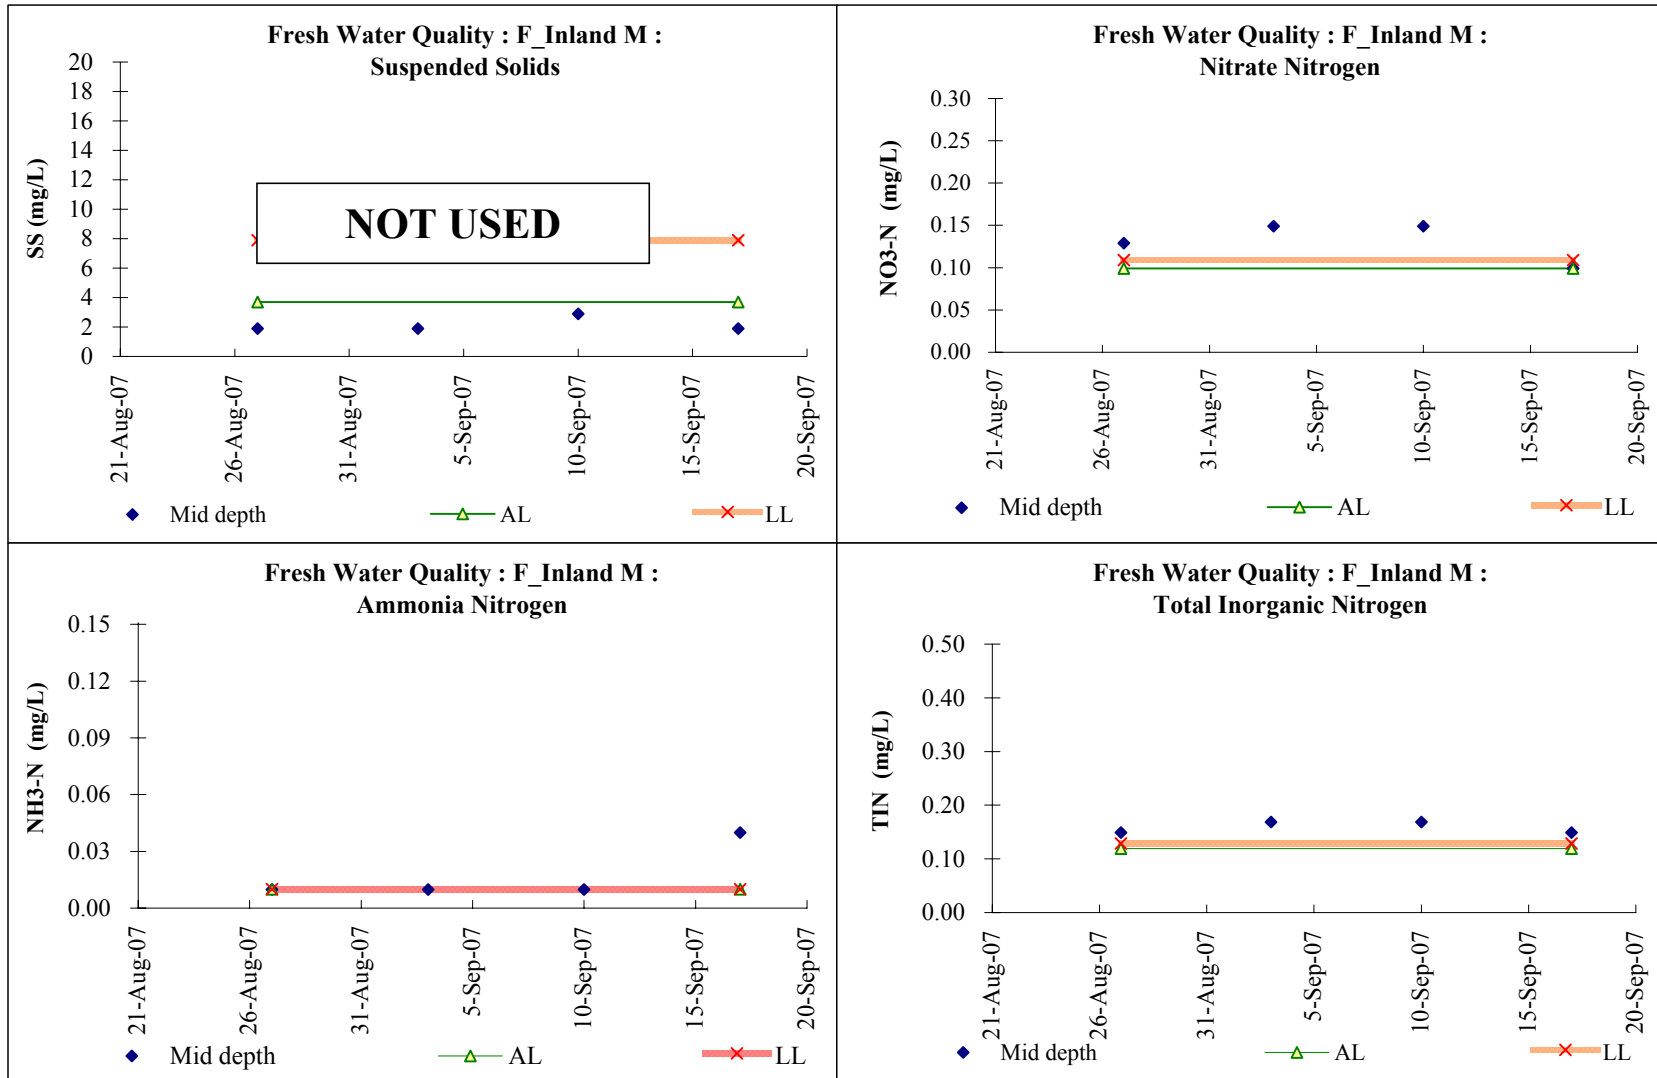

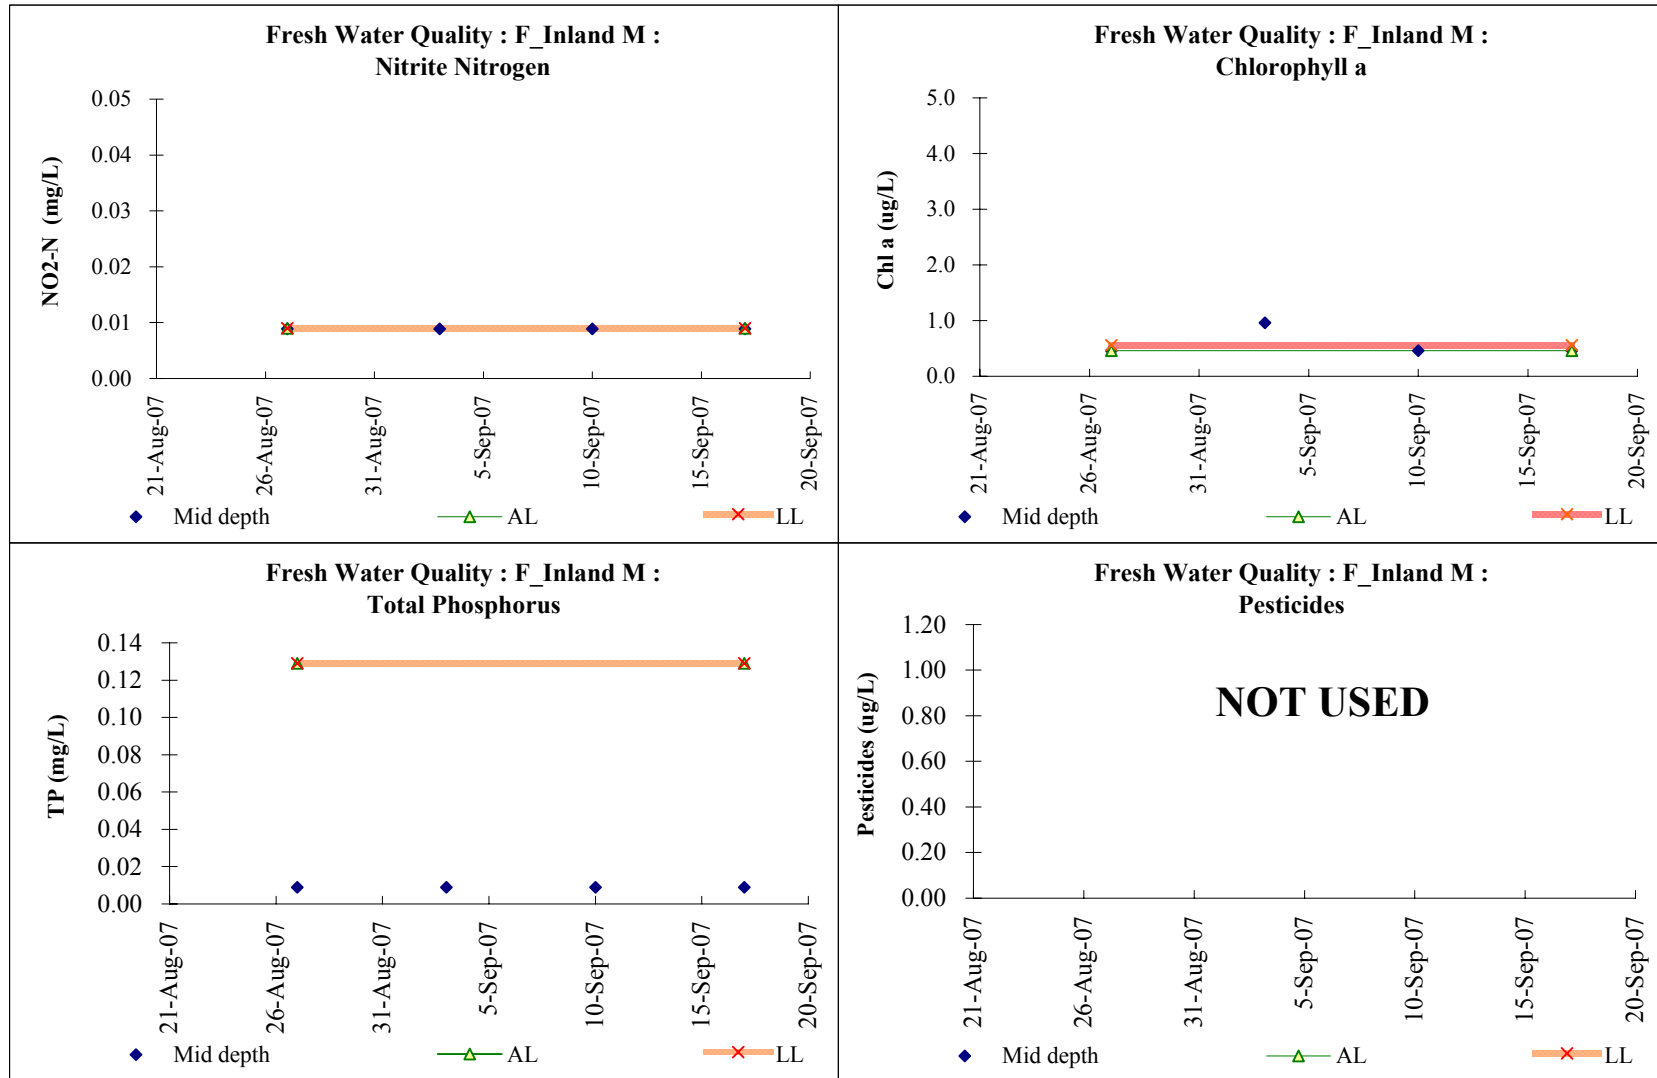

Ecology

Plate 5.3-1 Photos of Stream Habitat



Stream A and Buffer Zone



Stream A upstream to the permanent bridge



New drain near Stream B2



Stream B2 close-up



Freshwater snails



Atyid shrimp in Stream B



Stream C buffer zone




Stream C: sediment on aquatic plants



Atyid Shrimp in Stream D



Stream D

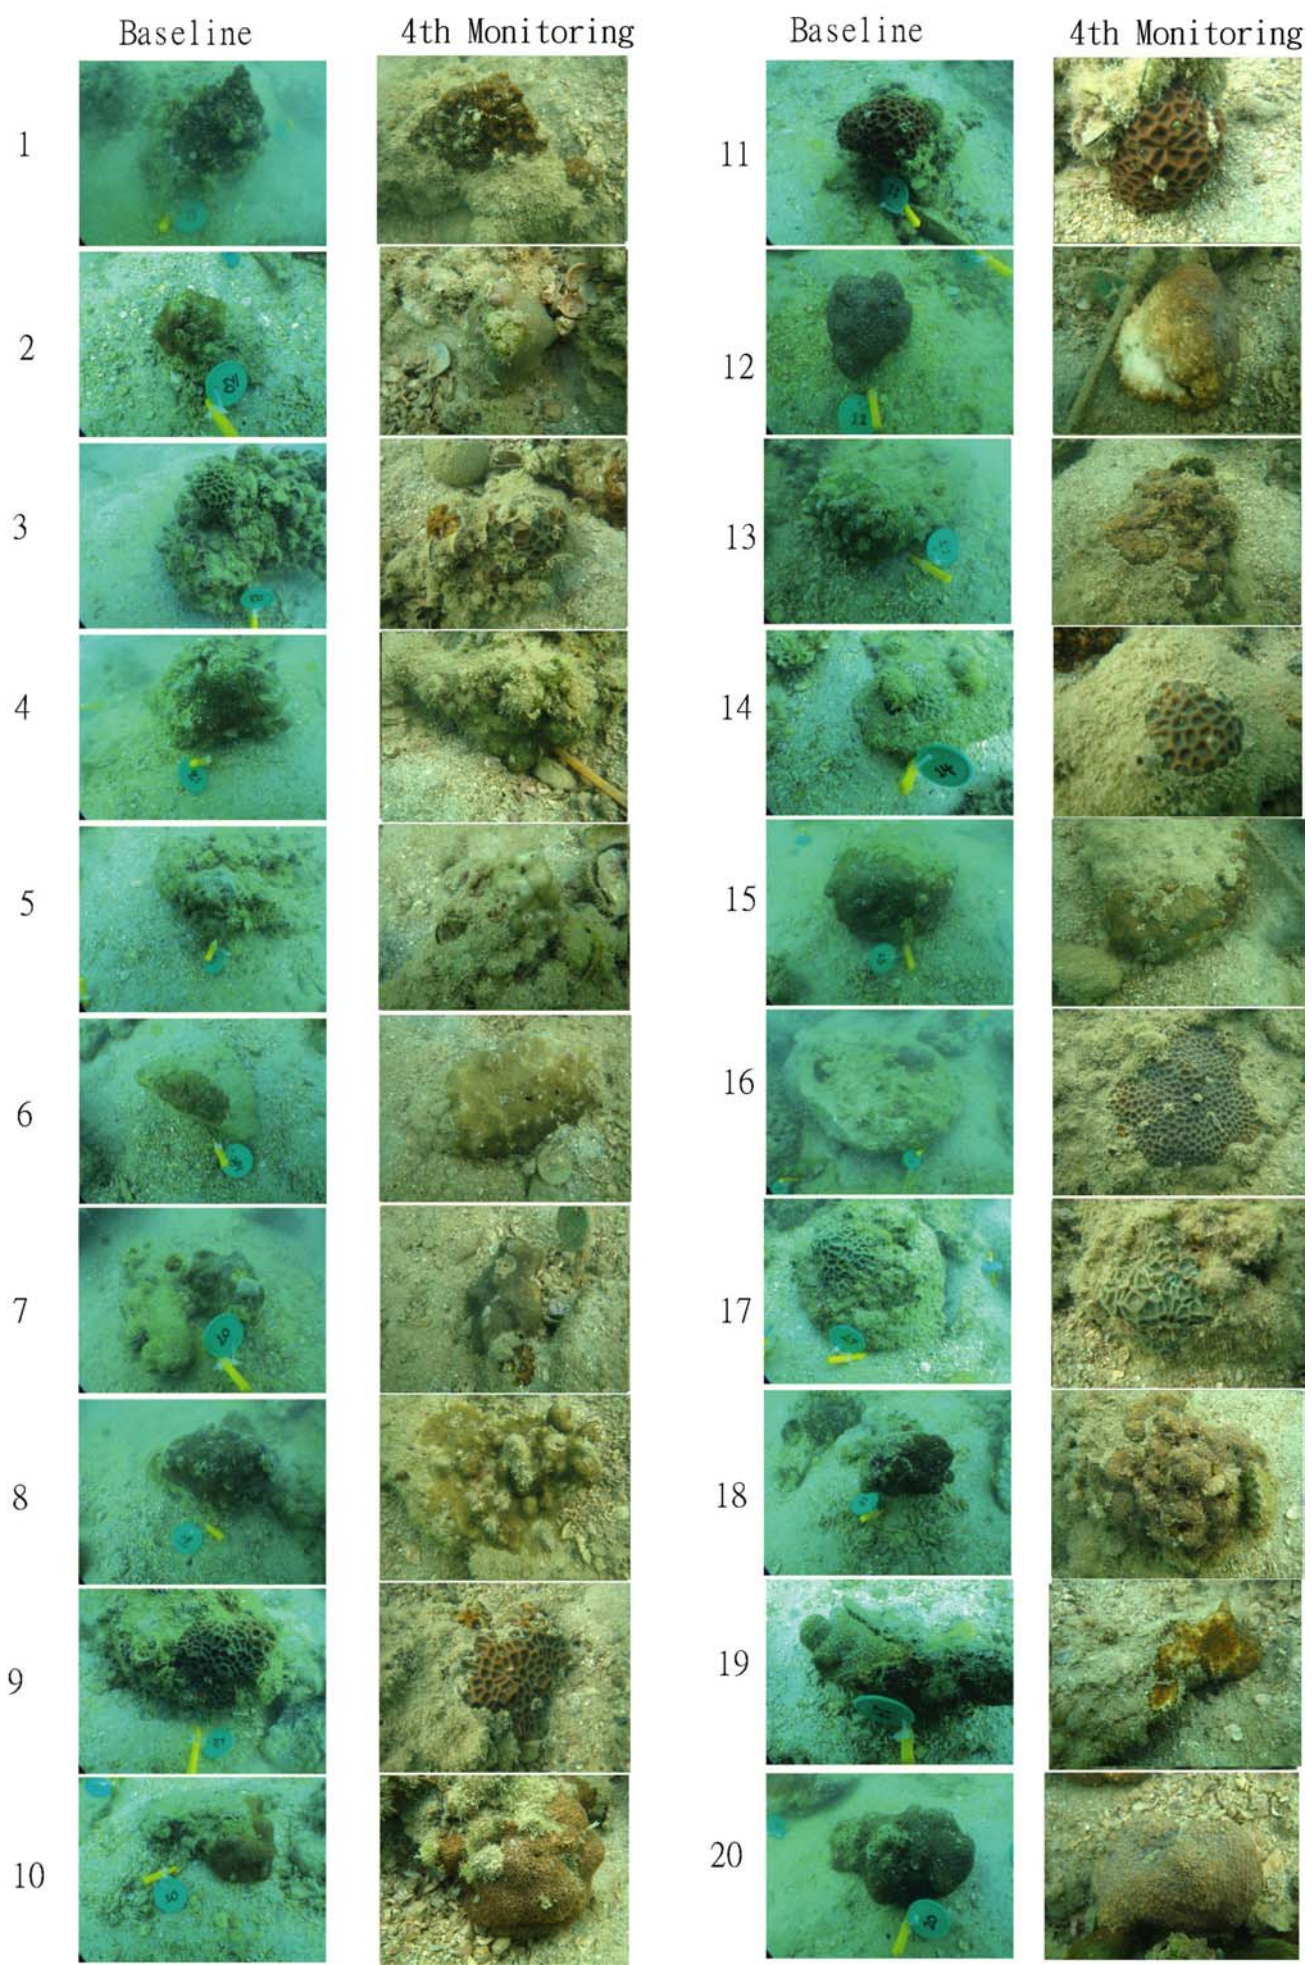


Baseline

4th monitoring


Baseline

4th monitoring

21

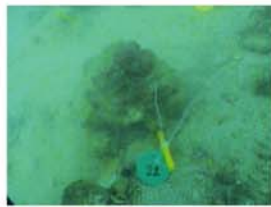

31

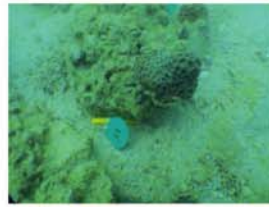

22



32





23



33



24

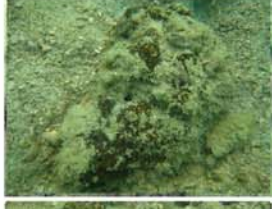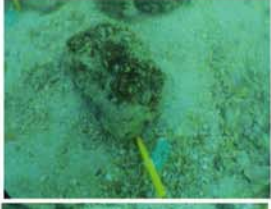


34



25



35

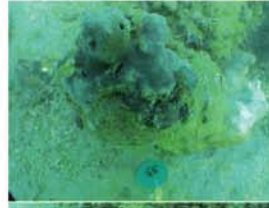

26




36




27




37

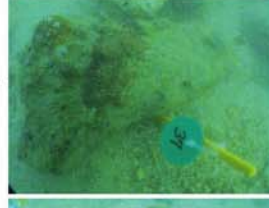

28

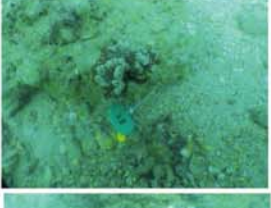


38

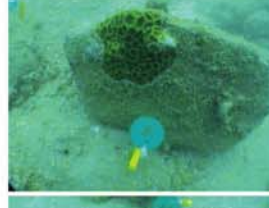

29



39

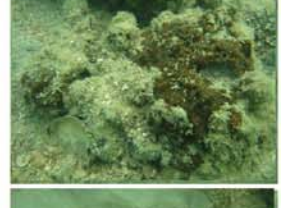

30



40




Baseline

4th monitoring

Baseline

4th monitoring


41

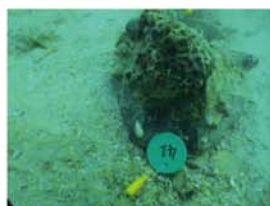


51




42

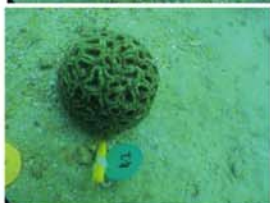


52

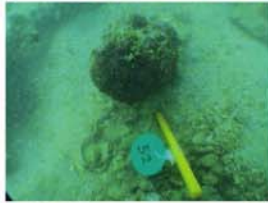

43

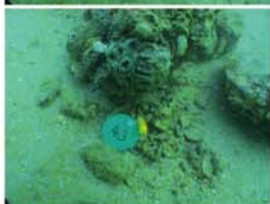


53

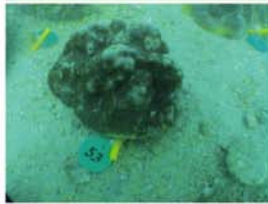


44




54

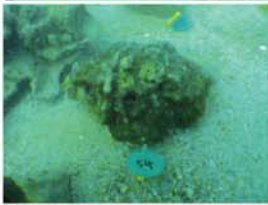

45

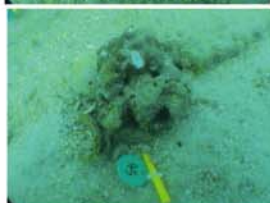

55

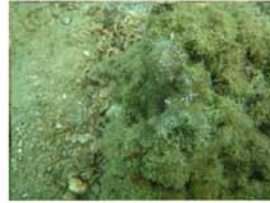

46



56




47



57



48

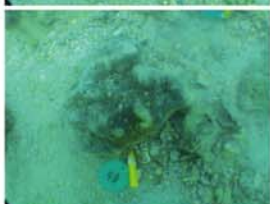

58




49



59



50

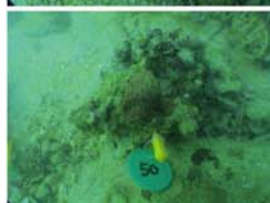

60



Baseline

4th monitoring

Baseline

4th monitoring

61



71




Missing

62



72

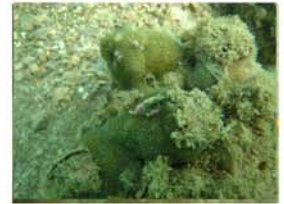


63



73



64

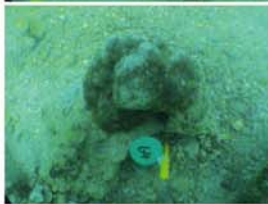



74



65



75

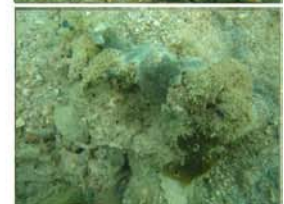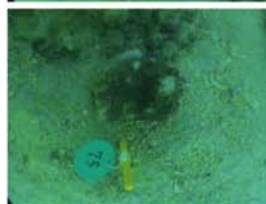

66



76



67



77




68



Missing


78

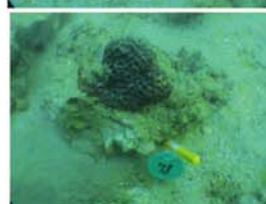

69



79

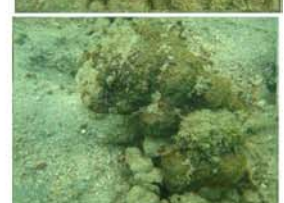

70



80



Baseline

3rd monitoring

81




Missing


82



83

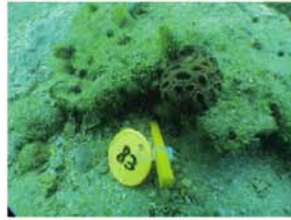

84

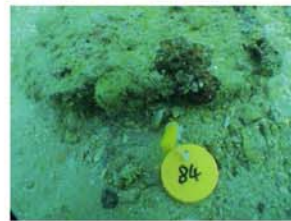

85




86




87



88

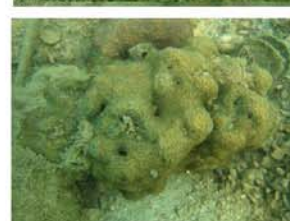


89

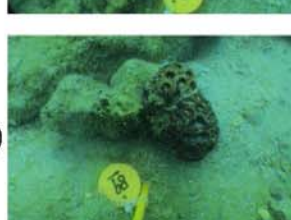


Baseline in Dec 05

Month 21 (Sep 07)


B-11

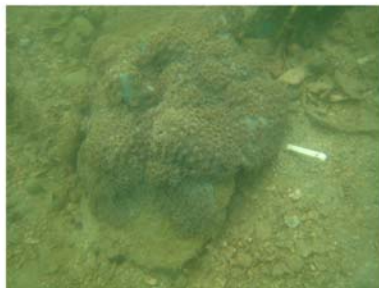

B-12

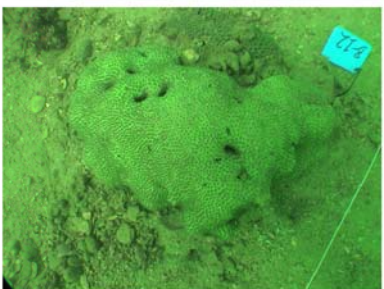

B-13

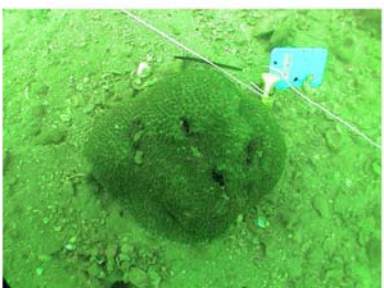

B-14



B-15



Baseline in Dec 05

Month 21 (Sep 07)

B-16



Missing

B-17



B-18



B-19



Missing

B-20



Baseline in April 06

Month 21 (Sep 07)


Baseline in April 06

Month 21 (Sep 07)

B-21



B-26

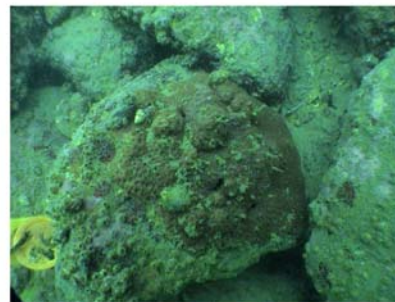


B-22



B-27



B-23

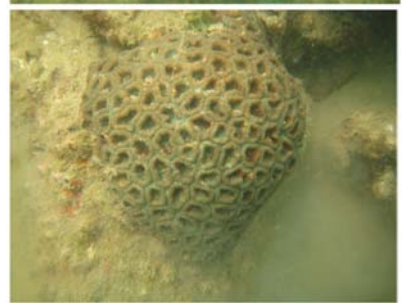

B-28




B-24



B-29



B-25

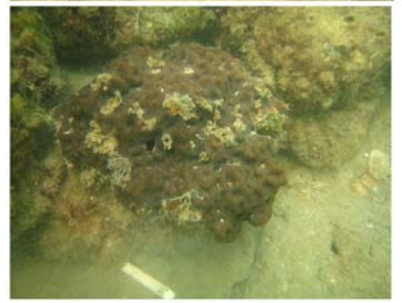

B-30



Baseline in April 06

Month 21 (Sep 07)

B-31



B-32



B-33



B-34



B-35



Baseline in April 06

Month 21 (Sep 07)


B-36




B-37



B-38

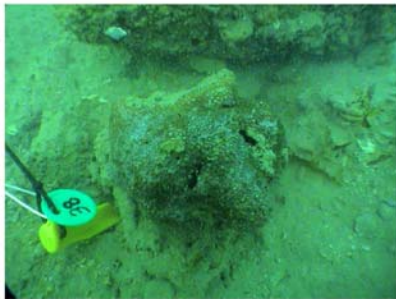

B-39

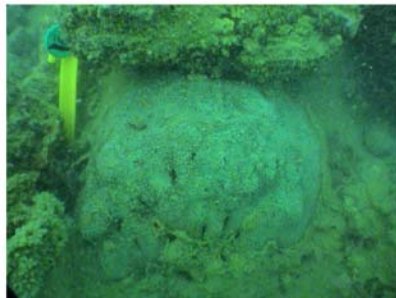

B-40



Baseline in April 06

Month 21 (Sep 07)

B-41



B-42




B-43



B-44



B-45

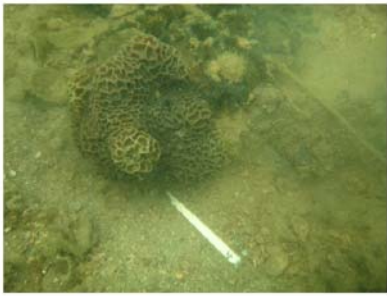


Baseline in April 06

Month 21 (Sep 07)

B-46



B-47

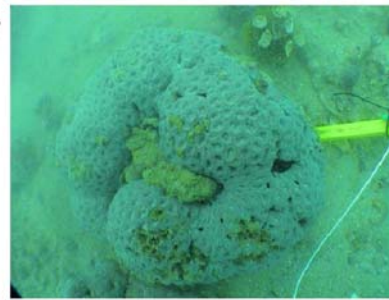

B-48



B-49



B-50



Missing

Baseline in April 06

Month 21 (Sep 07)

B-51




Missing

B-52



B-53

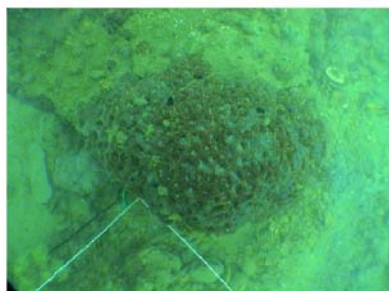

B-54



B-55




Baseline in April 06

Month 21 (Sep 07)

B-56



B-57

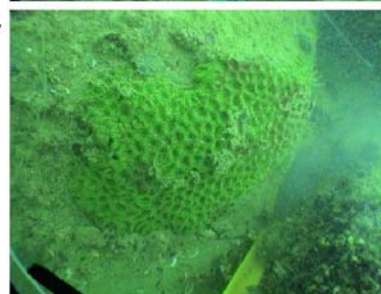

B-58



B-59



Missing

B-60



Missing

Baseline in Dec 05

Month 21 (Sep 07)


C-11



C-12



C-13

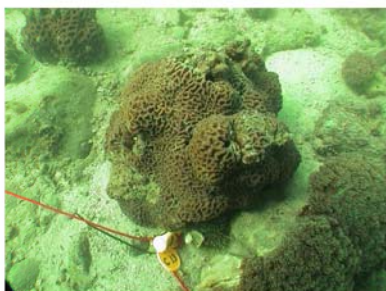

C-14



C-15



Baseline in Dec 05

Month 21 (Sep 07)

C-16



C-17




C-18



C-19



C-20

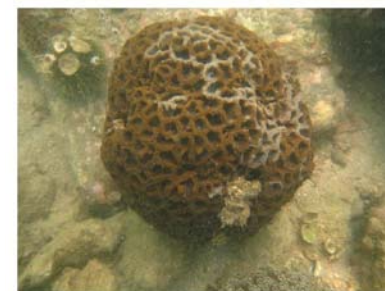

Baseline in Dec 05

Month 21 (Sep 07)

X-01




X-02




X-03



X-04

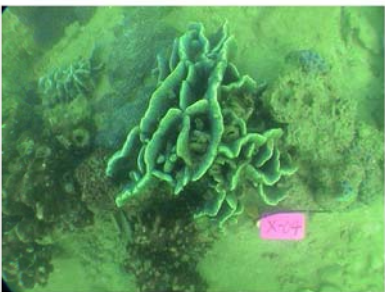

X-05

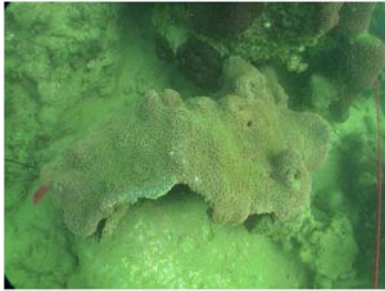

Missing

Baseline in Dec 05

Month 21 (Sep 07)

X-06



X-07



X-08



X-09




X-10




Baseline in Dec 05

Month 21 (Sep 07)

X-11

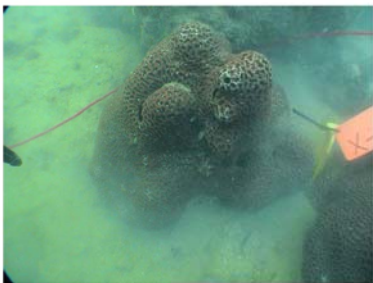

X-12

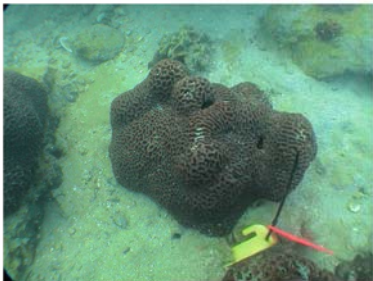

X-13



X-14



X-15



Baseline in Dec 05

Month 21 (Sep 07)

X-16



X-17




X-18



X-19



X-20

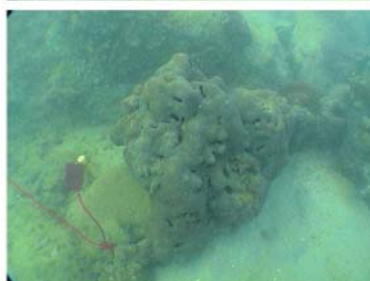

Annex F

Calibration Certificates

Maunsell Environmental Management Consultants Ltd.
TSP High Volume Sampler
Field Calibration Report

Station KSC Public Golf Course Bungalow A (GCA B1) Operator: yuen
 Cal. Date: 21-Aug-07 Due Date 21-Oct-07
 Equipment No.: _____ Serial No. 9469

Ambient Condition			
Temperature, Ta (K)	302	Pressure, Pa (mmHg)	758.5

Orifice Transfer Standard Information					
Serial No:	988	Slope, mc	2.00577	Intercept, bc	-0.00146
Last Calibration Date:	05-Dec-06	$mc \times Qstd + bc = [DH \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	05-Dec-07	$Qstd = \{ [DH \times (Pa/760) \times (298/Ta)]^{1/2} - bc \} / mc$			

Calibration of TSP Sampler					
Resistance Plate No.	Orifice			HVS Flow Recorder	
	DH (orifice), in. of water	$[DH \times (Pa/760) \times (298/Ta)]^{1/2}$	Qstd (m ³ /min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Recorder Reading IC (CFM) Y-axis
18	11.5	3.37	1.68	50.0	49.62
13	10.2	3.17	1.58	46.0	45.65
10	7.6	2.74	1.36	38.0	37.71
7	5.4	2.31	1.15	32.0	31.76
5	3.0	1.72	0.86	22.0	21.83

By Linear Regression of Y on X
 Slope, mw = 33.3509 Intercept, bw = -6.9247
 Correlation Coefficient* = 0.9975
 *If Correlation Coefficient < 0.990, check and recalibrate.


Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 1.30m³/min
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = IC \times [(Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; IC = $(mw \times Qstd + bw) \times [(760 / Pa) \times (Ta / 298)]^{1/2} =$ 36.71

Remarks: _____

QC Reviewer: Eddie Yang Signature:  Date: 23.8.2007



CERTIFICATE OF ANALYSIS

CONTACT: MR WONG SIU HO
CLIENT: ENOVATIVE ENV TECHNOLOGY CO
ADDRESS: RM 3704 SIK MAN HOUSE
HOMANTIN ESTATE
KOWLOON

Batch: HK0710110
LABORATORY: HONG KONG
DATE RECEIVED: 05/07/2007
DATE OF ISSUE: 20/07/2007
SAMPLE TYPE: EQUIPMENT
No. of SAMPLES: 2

ORDER No.:

COMMENTS

The calibration procedure used for the analysis has been applied for the calibration of the above instrument.

NOTES


This is the Final Report and supersedes any preliminary report with this batch number.
Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd
11/F
Chung Shun Knitting Centre
1-3 Wing Yip Street
Kwai Chung
HONG KONG

Phone: 852-2610 1044
Fax: 852-2610 2021
Email: hongkong@alsenviro.com

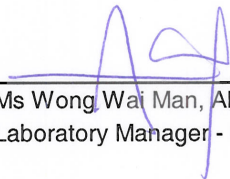
Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

Other ALS Environmental Laboratories

AUSTRALIA		AMERICAS
Brisbane	Hong Kong	Vancouver
Melbourne	Singapore	Santiago
Sydney	Kuala Lumpur	Amtofagasta
Newcastle	Bogor	Lima

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

CERTIFICATE OF ANALYSIS




Batch: HK0710110
Date of Issue: 20/07/2007
Client: ENOVATIVE ENV TECHNOLOGY CO
Client Reference:

Calibration of Turbidimeter

Item : HACH Turbidimeter
Model No. : HACH 2100P
Serial No. : 010800023043
Calibration Method : This meter was calibrated in accordance with standard method APHA (19th Ed.) 2130B
Date of Calibration : 05 July, 2007

Testing Results :

Expected Reading	Recording Reading
0.0 NTU	0.2 NTU
5.0 NTU	4.7 NTU
20.0 NTU	19.3 NTU
100 NTU	99.9 NTU
Allowing Deviation	±10%

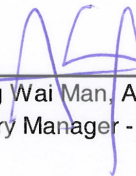
Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

CERTIFICATE OF ANALYSIS




Batch: HK0710110
Date of Issue: 20/07/2007
Client: ENOVATIVE ENV TECHNOLOGY CO
Client Reference:

Calibration of Salinity System

Item : YSI SONDE Environmental Monitoring System
Model No. : 6920
Serial No. : 000109DF
Calibration Method : This meter was calibrated in accordance with standard method APHA (19th Ed.) 2520 A and B
Date of Calibration : 05 July, 2007

Testing Results :

Expected Reading	Recording Reading
20.0 g/L	19.9 g/L
30.0 g/L	30.0 g/L
Allowing Deviation	±10%

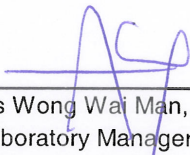
Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

CERTIFICATE OF ANALYSIS




Batch: HK0710110
Date of Issue: 20/07/2007
Client: ENOVATIVE ENV TECHNOLOGY CO
Client Reference:

Calibration of Thermometer

Item : YSI SONDE Environmental Monitoring System
Model No. : 6920
Serial No. : 000109DF
Calibration Method : In-house Method
Date of Calibration : 05 July, 2007

Testing Results :

Reference Temperature (°C)	Recorded Temperature (°C)
0.5 °C	0.4 °C
20.1 °C	20.5 °C
Allowing Deviation	±2.0°C


Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

CERTIFICATE OF ANALYSIS




Batch: HK0710110
Date of Issue: 20/07/2007
Client: ENOVATIVE ENV TECHNOLOGY CO
Client Reference:

Calibration of DO System

Item : YSI SONDE Environmental Monitoring System
Model No. : 6920
Serial No. : 000109DF
Calibration Method : This meter was calibrated in accordance with standard method APHA (18th Ed.) 4500-OC & G
Date of Calibration : 05 July, 2007

Testing Results :

Expected Reading	Recording Reading
0.0 mg/L	0.1 mg/L
2.3 mg/L	2.2 mg/L
5.7 mg/L	5.6 mg/L
7.4 mg/L	7.5 mg/L
Allowing Deviation	±0.2 mg/L

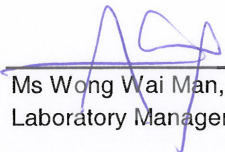
Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

CERTIFICATE OF ANALYSIS




Batch: HK0710110
Date of Issue: 20/07/2007
Client: ENOVATIVE ENV TECHNOLOGY CO
Client Reference:

Calibration of pH System

Item : YSI SONDE Environmental Monitoring System
Model No. : 6920
Serial No. : 000109DF
Calibration Method : This meter was calibrated in accordance with standard method APHA (19th Ed.) 4500 H:B
Date of Calibration : 05 July, 2007

Testing Results :

Expected Reading	Recording Reading
4.0	4.0
7.0	7.0
10.0	10.0
Allowing Deviation	±0.2 unit

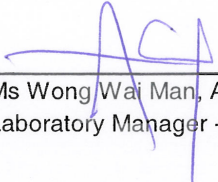
Ms Wong Wai Man, Alice
Laboratory Manager - Hong Kong

Annex G

Monitoring Programme for the next three months

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung
 Monthly EM&A Report

October 2007						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
	1	2	3	4 LV	5 AQ	6
7	8 WQ	9	10	11 AQ	12	13
14	15 WQ	16	17 AQ	18 TE LV	19 TE	20
21	22 WQ	23 AQ	24	25	26	27
28	29 WQ AQ	30	31			

November 2007						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
				1 LV	2	3 AQ
4	5 WQ	6	7	8	9 AQ	10
11	12 WQ	13	14	15 AQ LV	16	17
18	19 WQ	20	21 AQ	22 TE	23 TE	24
25	26 WQ	27 AQ	28	29	30	

December 2007						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
						1
2	3 WQ AQ	4	5	6 LV	7	8 AQ
9	10 WQ	11	12	13 LV	14 AQ	15
16	17 WQ	18	19	20 AQ TE	21 TE	22
23	24 WQ	25	26 AQ	27	28	29
30	31 WQ					

Remarks: AQ = TSP, WQ = Freshwater and Marine water quality, TE = Terrestrial Ecology, ME = Marine Ecology, LV = Landscape & Visual.


No exceedance was found during the three months of coral monitoring (Apr – Jun 06) at the temporary barging point after the coral incident (23rd Mar 06), the monitoring frequency will be changed on quarterly basis (start from Sept 2006) till the end of the construction phase (Dec 06, Mar 07, Jun 07). According to the latest construction programme submitted by the Contractor, it will extend from July 07 to Dec 07. The monitoring will require to be extended to Dec 07 subject to the actual site progress.




No dredging was carried out for the desalination plant pipeline construction. However, corals at Site D2 were transplanted in the Dec 2006. Transplanted coral monitoring on quarterly basis for one year was commenced after the completion of coral transplanted in Dec 2006. The next monitoring of the transplanted coral will be carried out in Dec 07 (end of one year).

Planting turf is likely to be in mid-February 2007. Water quality monitoring and frequency will increase to three times a week for the first three months (mid-February to mid-May 2007), then decrease to weekly basis if no exceedance was recorded. The monitoring parameter will include nutrients and pesticides (only measured when actual application on site).

Annex H

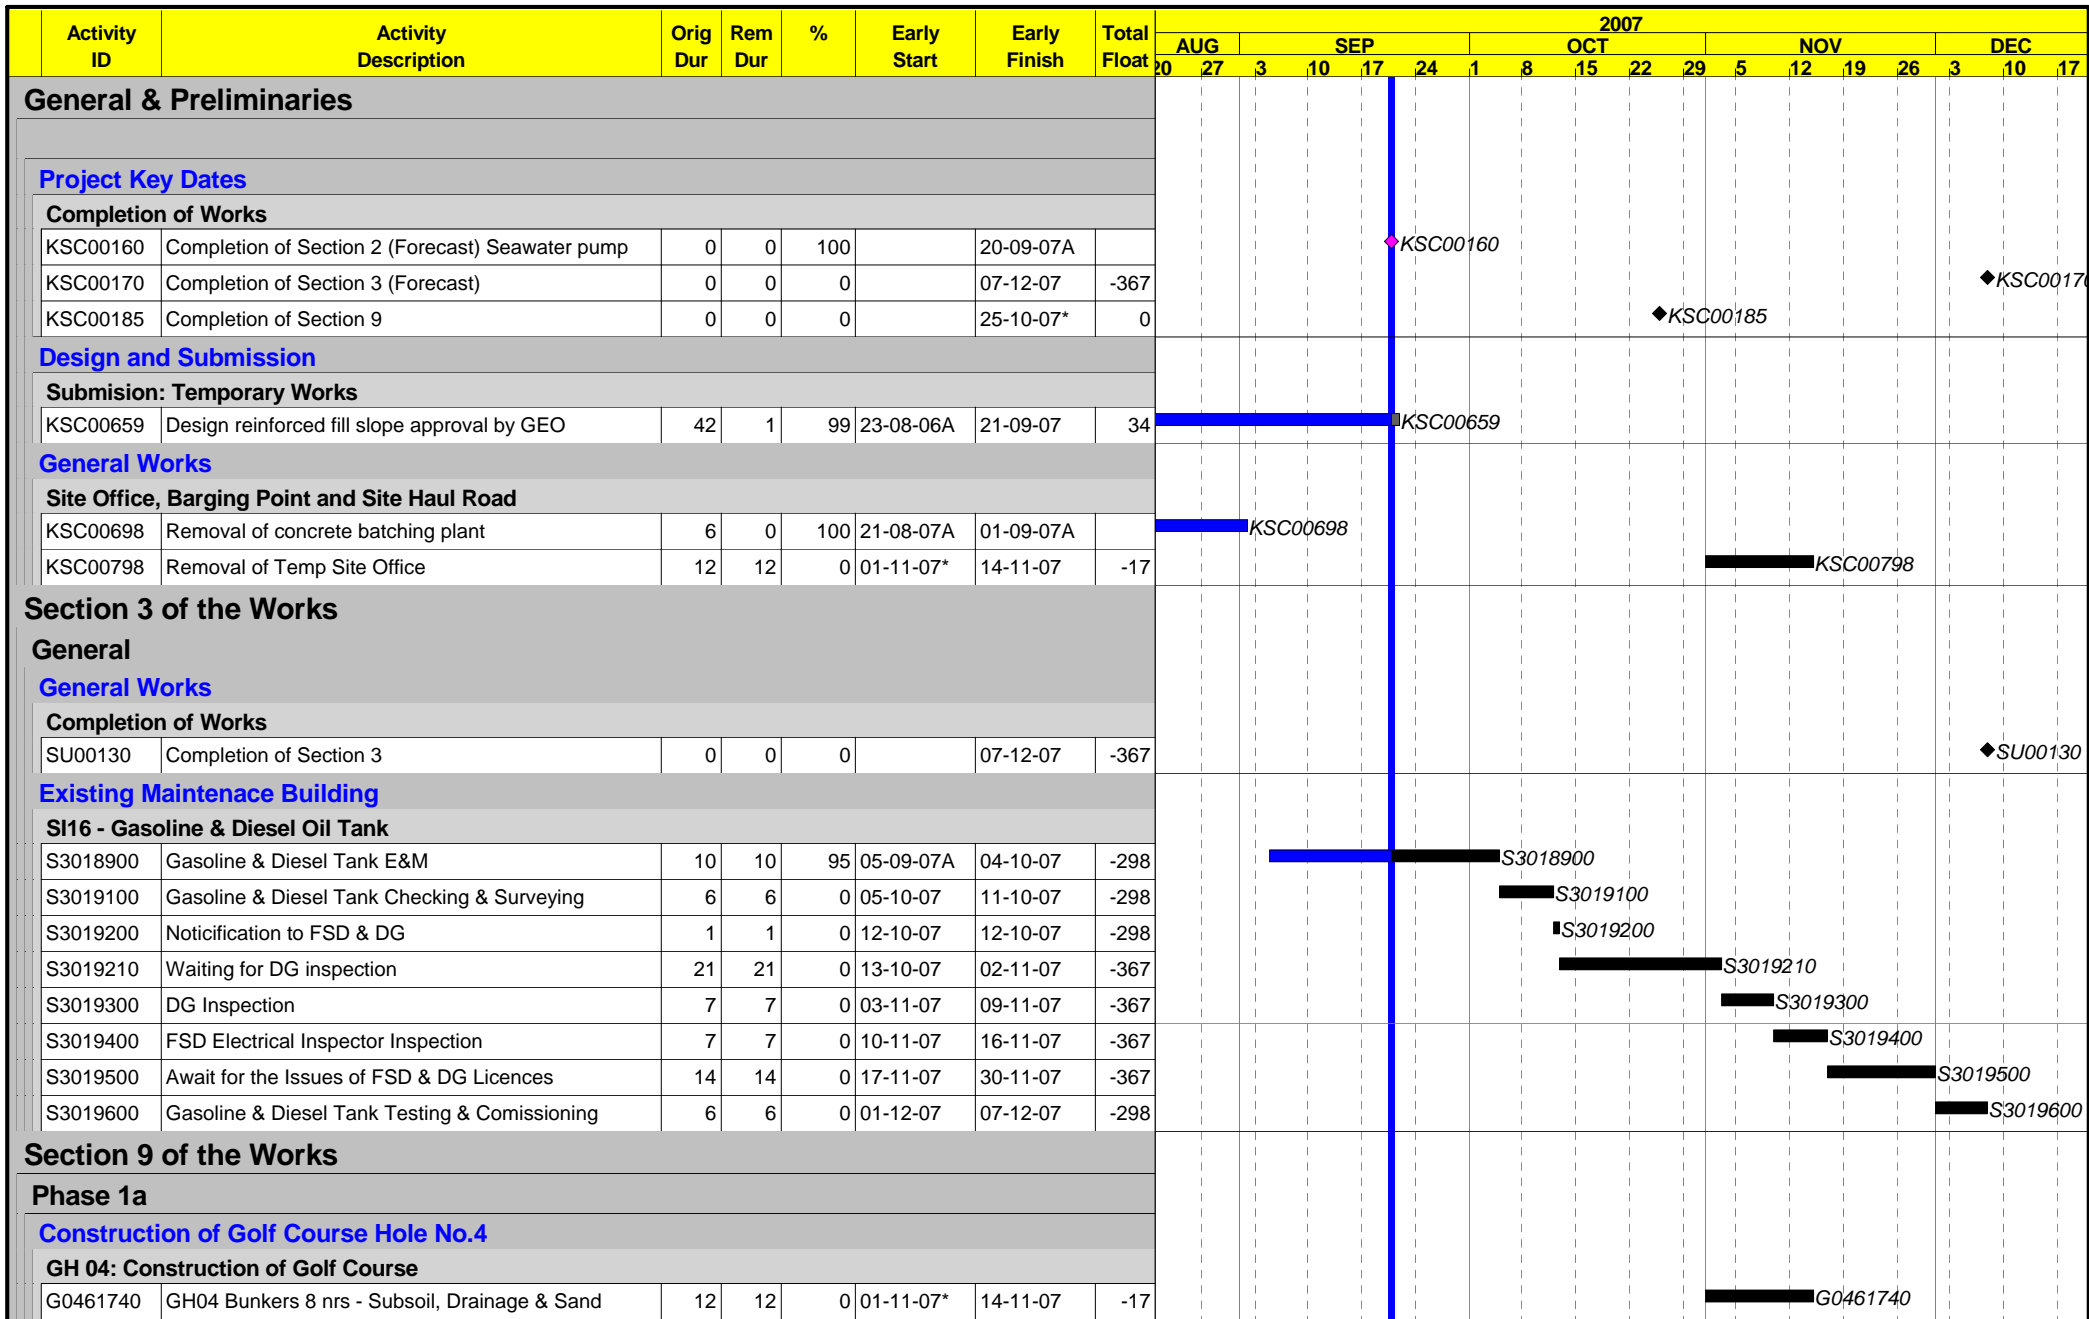Construction Programme for the next three months




Start Date	28-12-05	 Early Bar
Finish Date	27-03-08	 Progress Bar
Data Date	21-09-07	 Critical Activity
Run Date	05-10-07 15:04	

KS21	Sheet 1 of 9
------	--------------

China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

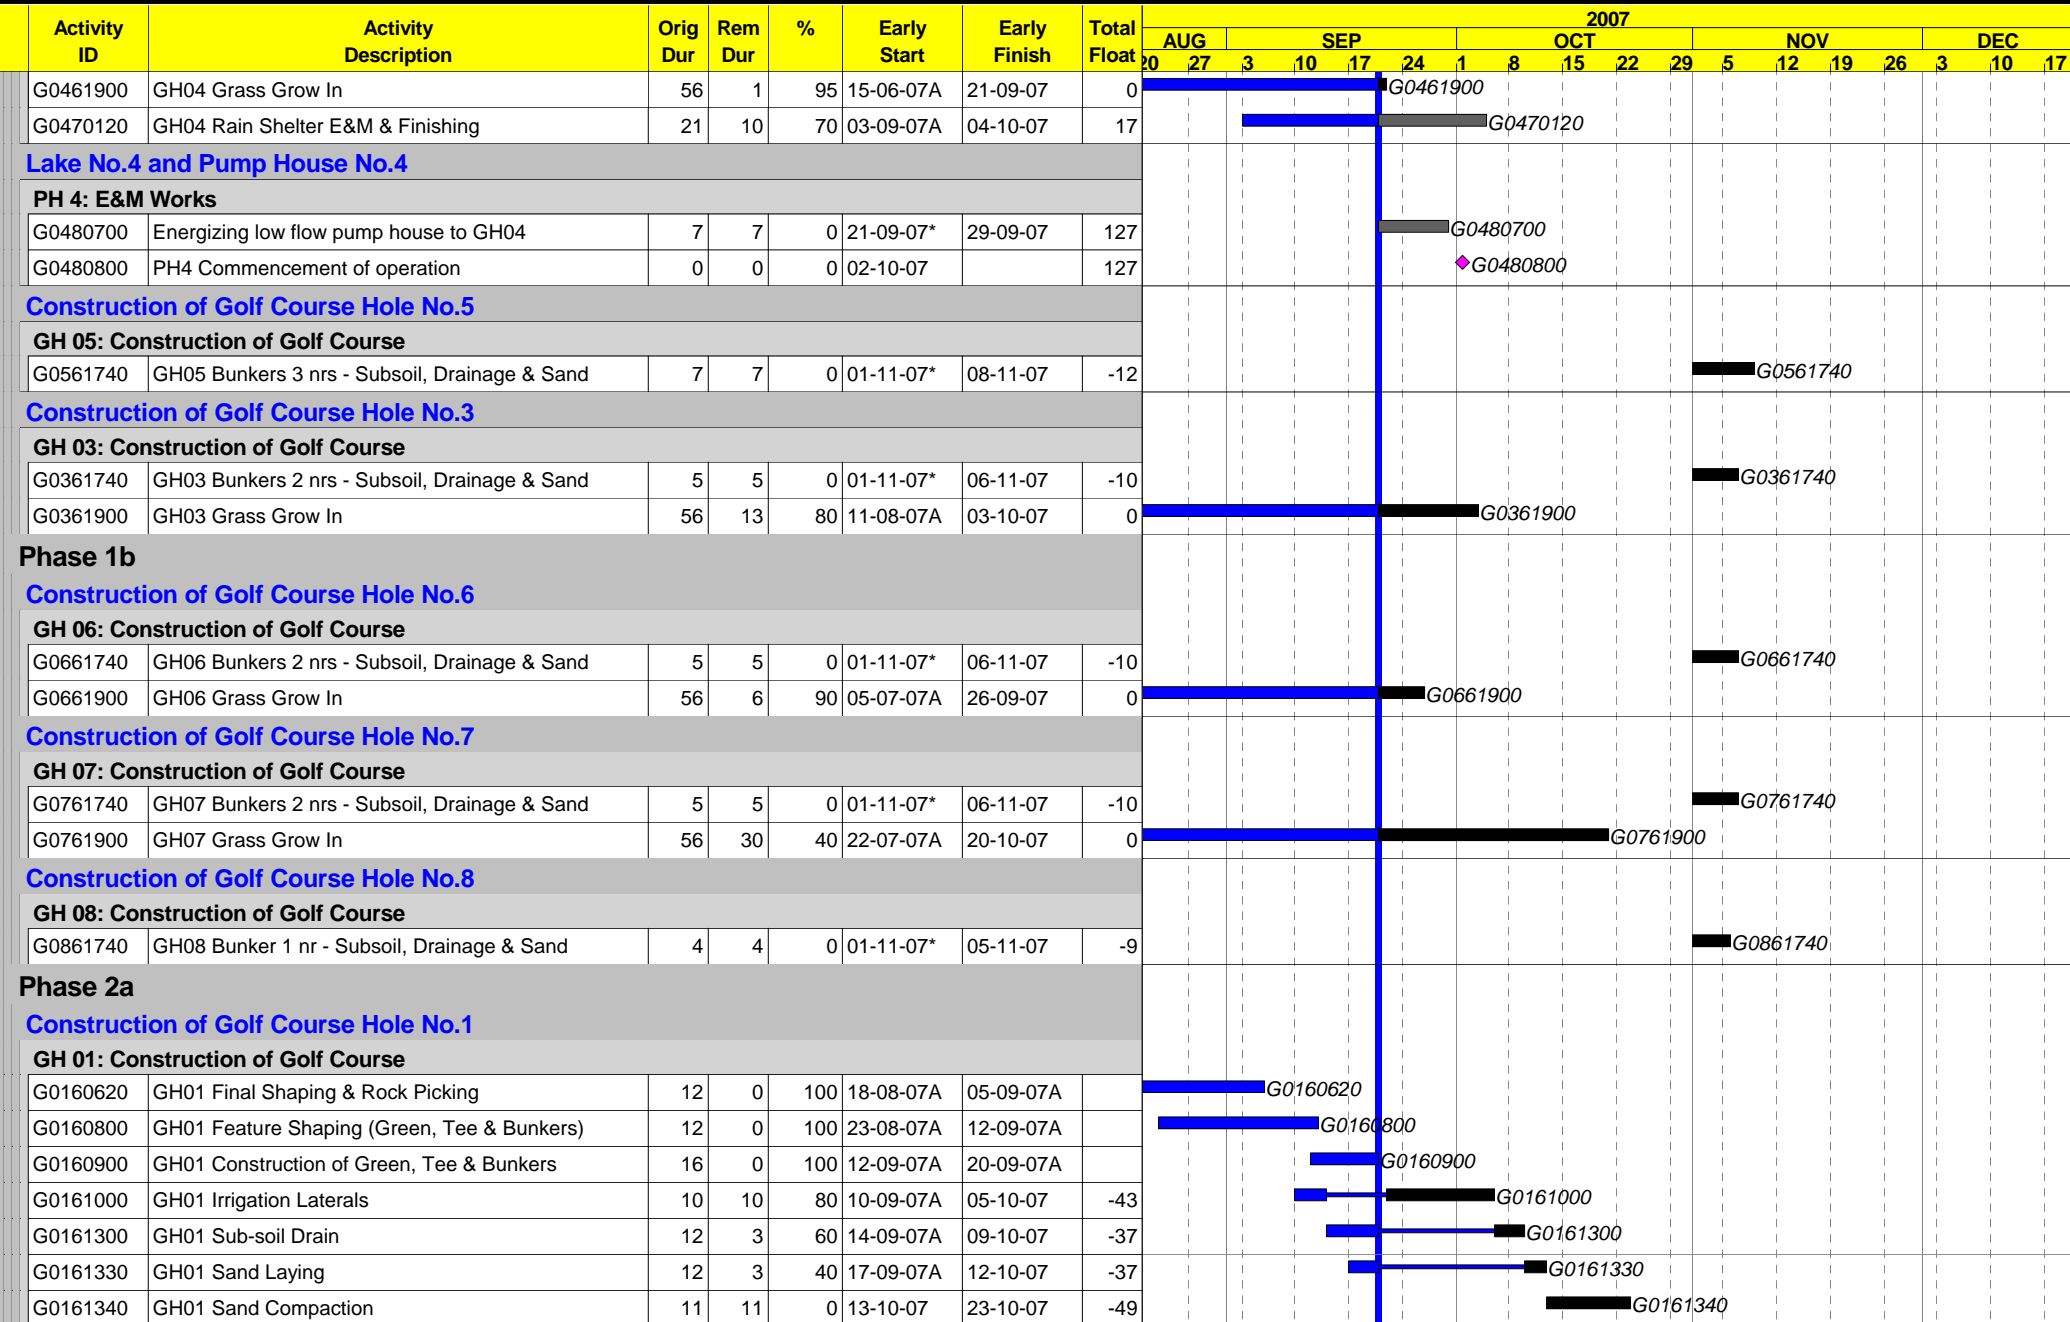


Start Date 28-12-05
 Finish Date 27-03-08
 Data Date 21-09-07
 Run Date 05-10-07 15:04

Early Bar
 Progress Bar
 Critical Activity

KS21
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Sheet 2 of 9

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

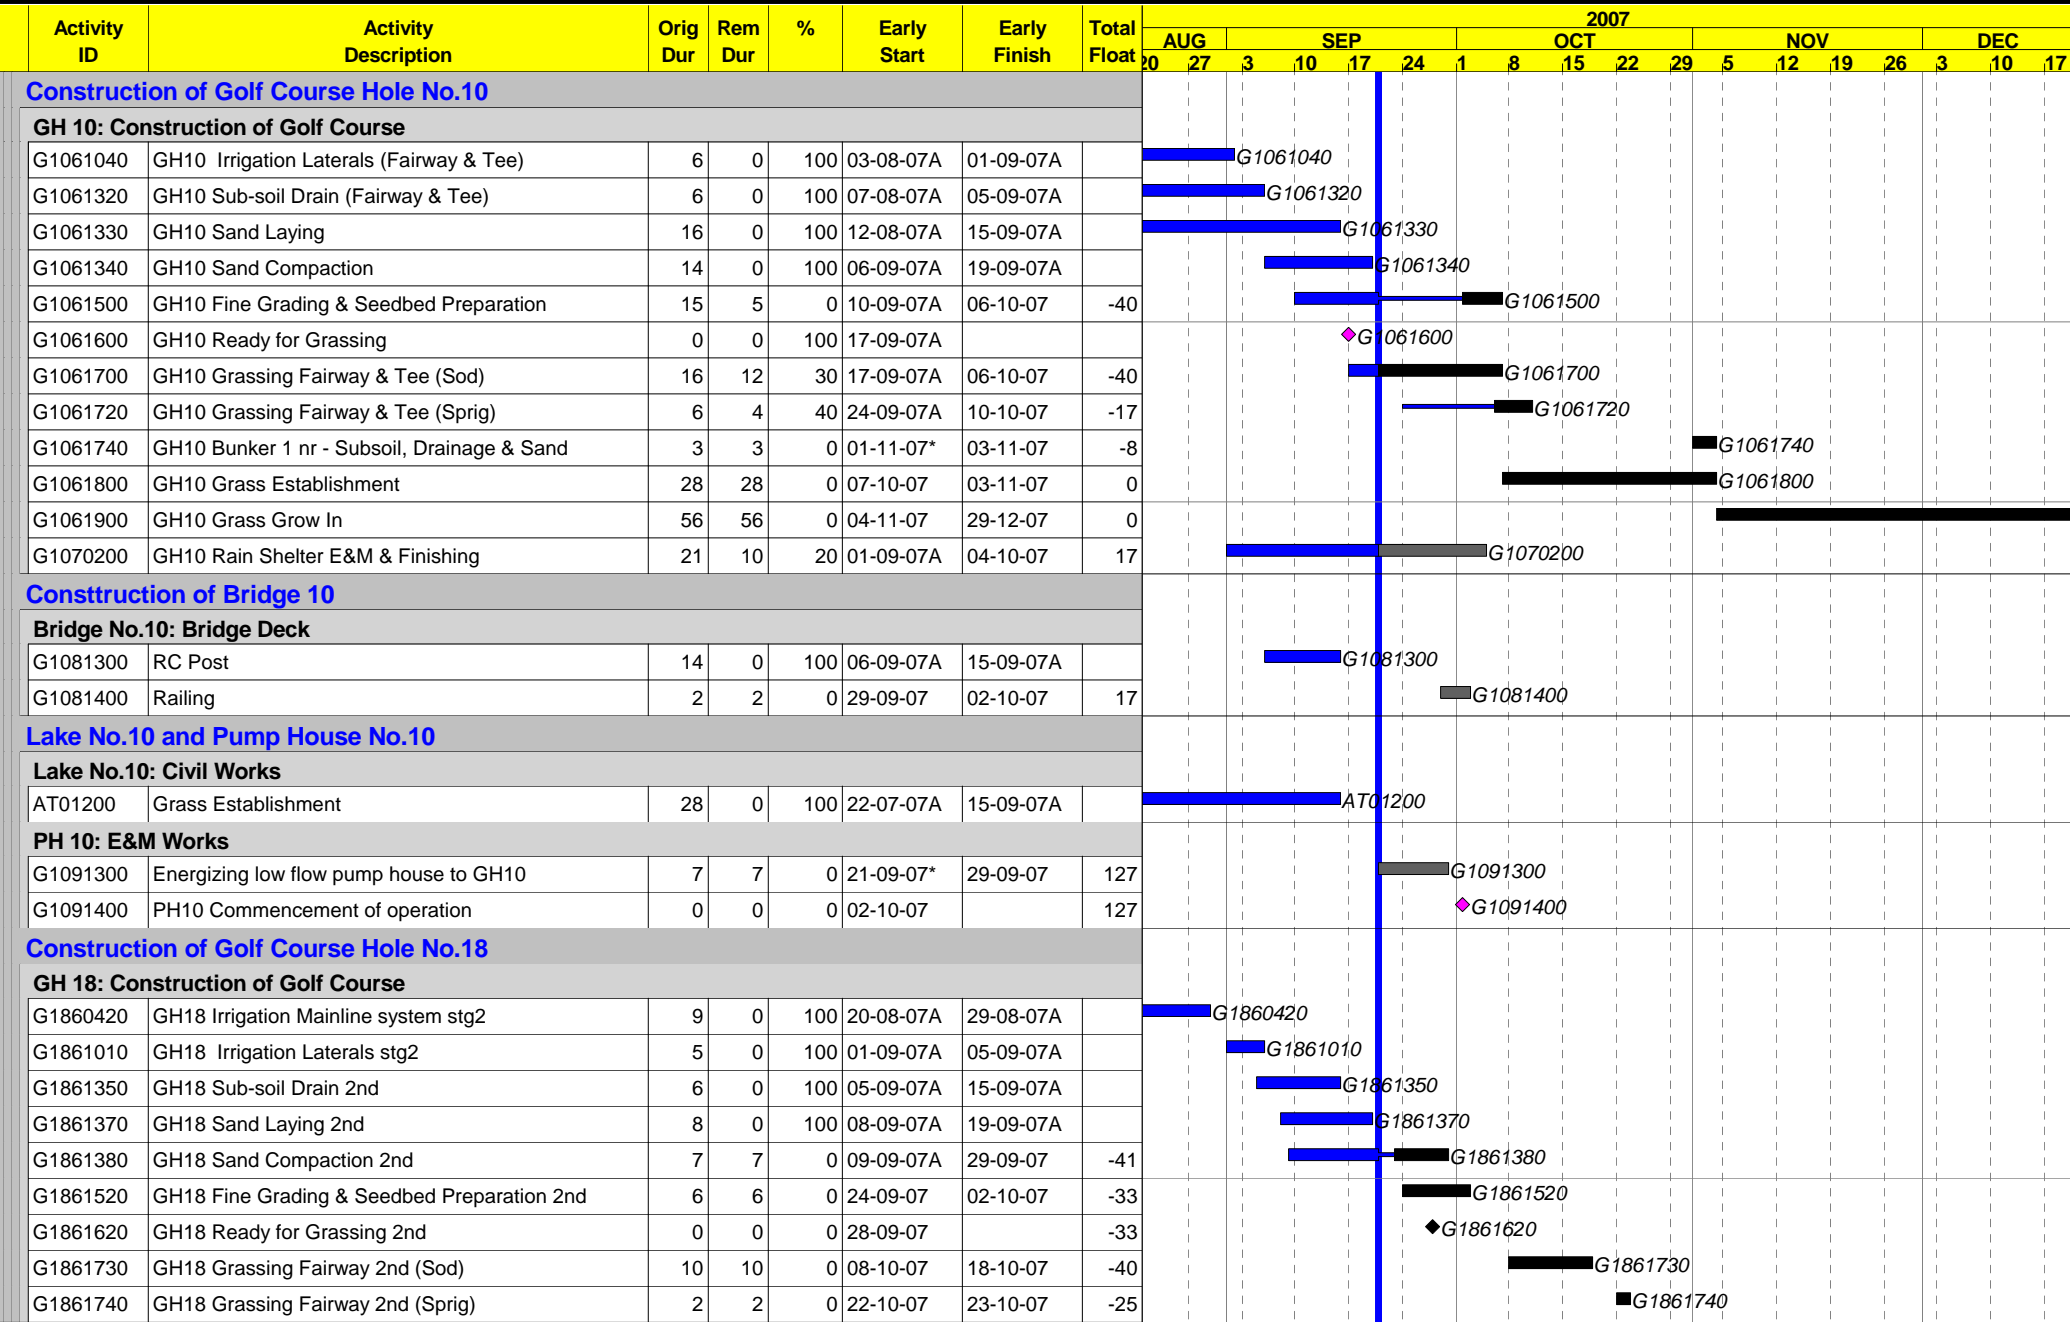


Start Date 28-12-05
 Finish Date 27-03-08
 Data Date 21-09-07
 Run Date 05-10-07 15:04

Early Bar
 Progress Bar
 Critical Activity

KS21
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Sheet 4 of 9

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

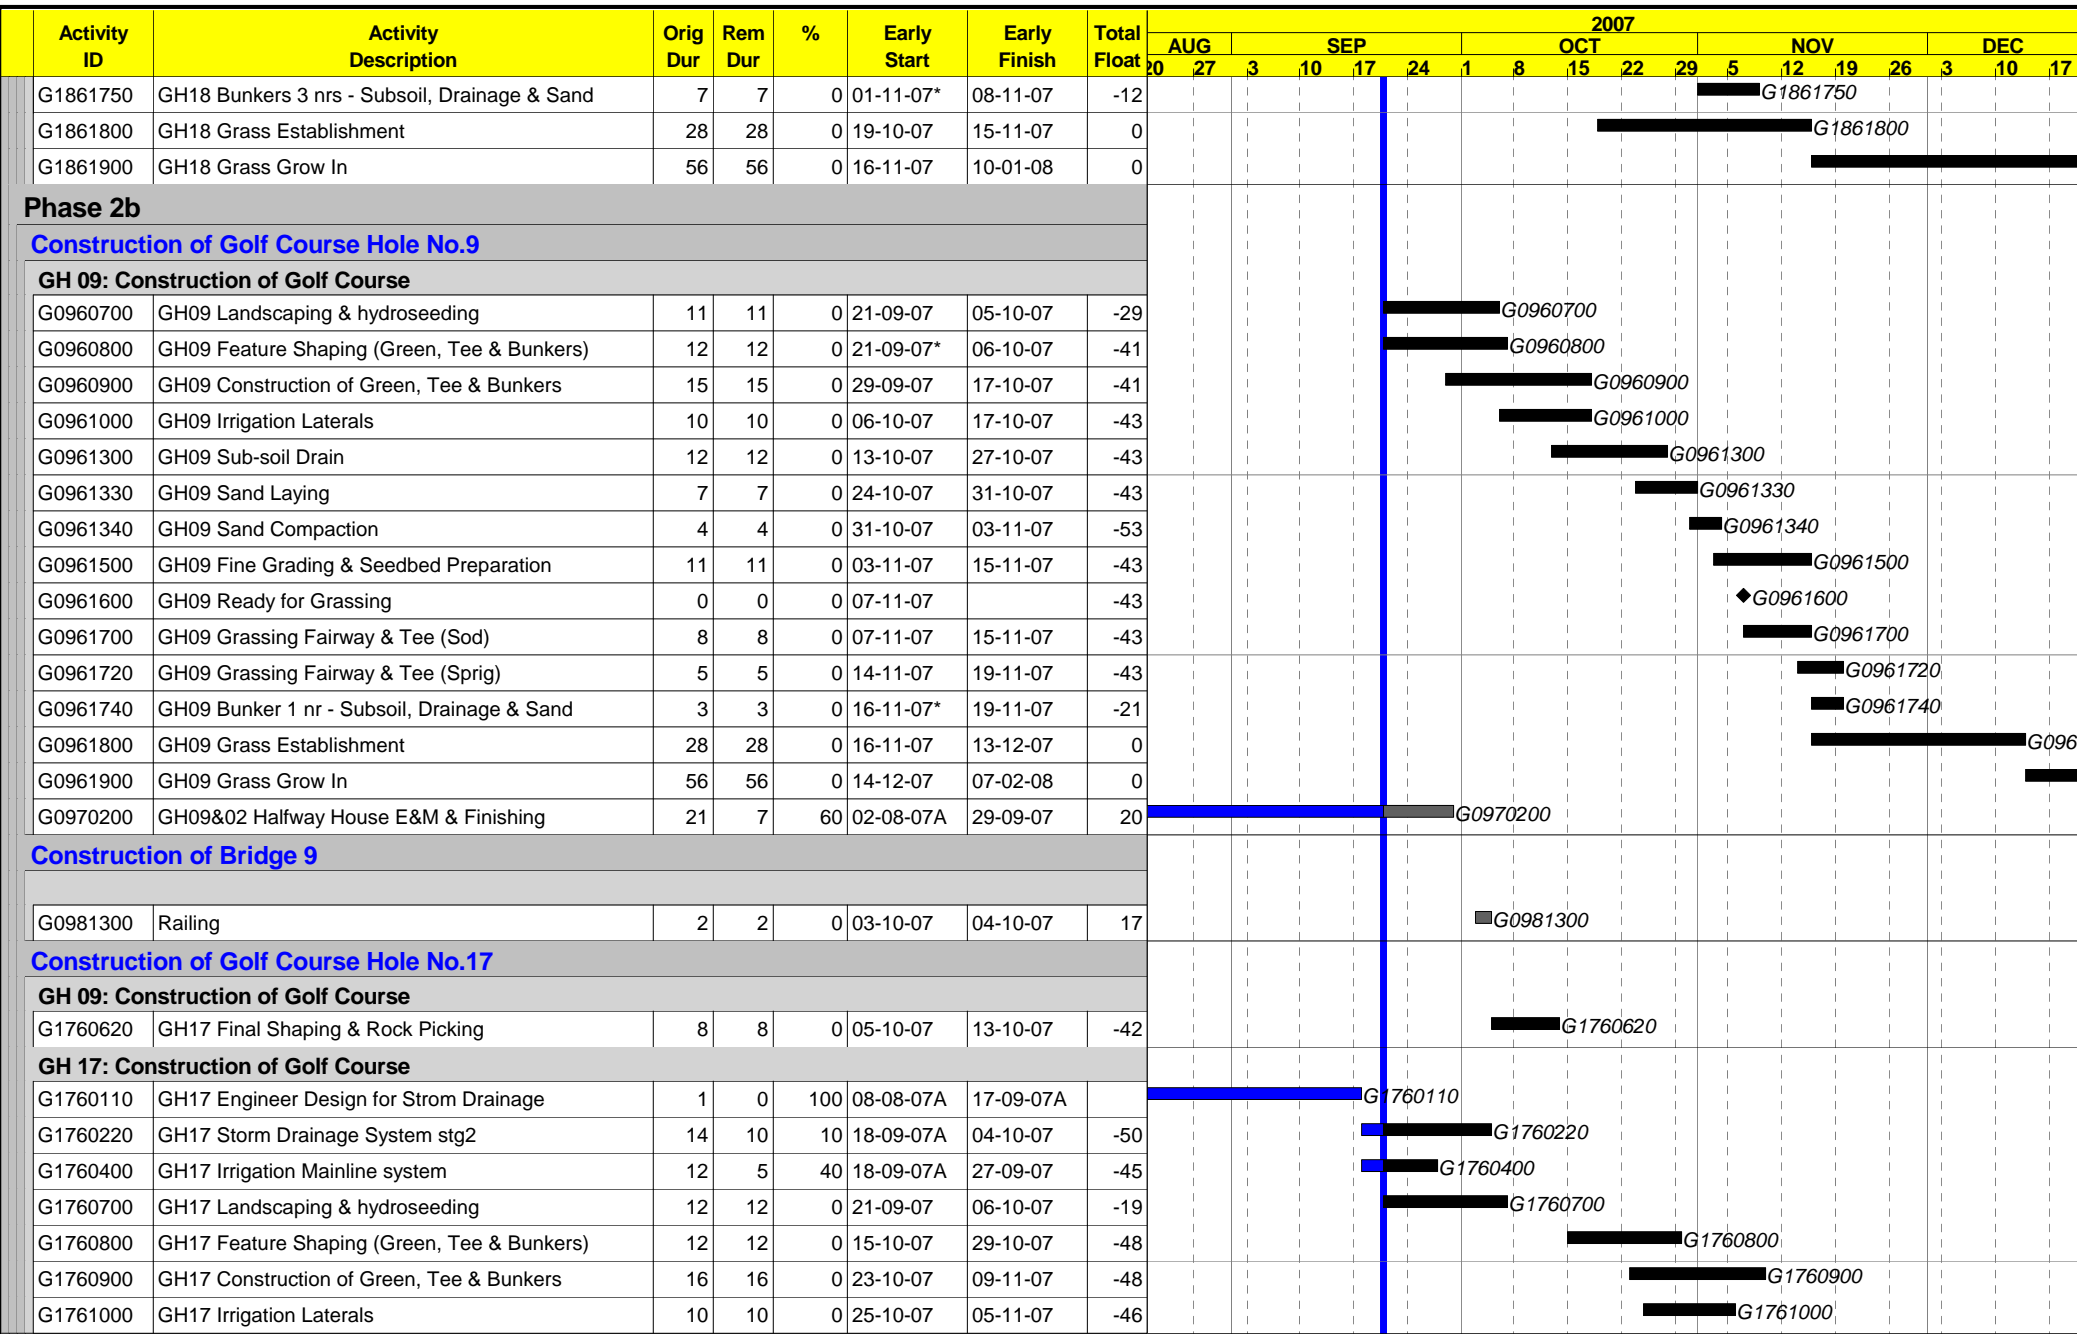

Start Date	28-12-05
Finish Date	27-03-08
Data Date	21-09-07
Run Date	05-10-07 15:04

Early Bar
Progress Bar
Critical Activity

KS21
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Sheet 5 of 9

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	


Activity ID	Activity Description	Orig Dur	Rem Dur	%	Early Start	Early Finish	Total Float	2007													
								AUG			SEP			OCT			NOV			DEC	
								20	27	3	10	17	24	1	8	15	22	29	5	12	19
G1761300	GH17 Sub-soil Drain	12	12	0	03-11-07	16-11-07	-48														
G1761330	GH17 Sand Laying	8	8	0	12-11-07	20-11-07	-48														
G1761340	GH17 Sand Compaction	7	7	0	17-11-07	23-11-07	-59														
G1761500	GH17 Fine Grading & Seedbed Preparation	12	12	0	20-11-07	03-12-07	-47														
G1761600	GH17 Ready for Grassing	0	0	0	23-11-07		-47														
G1761700	GH17 Grassing Fairway & Tee (Sod)	12	12	0	23-11-07	06-12-07	-47														
G1761720	GH17 Grassing Fairway & Tee (Sprig)	7	7	0	03-12-07	10-12-07	-44														
G1761740	GH17 Bunkers 2 nrs - Subsoil, Drainage & Sand	4	4	0	07-12-07*	11-12-07	-40														
G1761800	GH17 Grass Establishment	28	28	0	07-12-07	03-01-08	0														
Phase 3a																					
Construction of Golf Course Hole No.14																					
GH 14: Construction of Golf Course																					
G1461340	GH14 Sand Compaction	8	0	100	13-08-07A	22-08-07A															
G1461500	GH14 Fine Grading & Seedbed Preparation	8	0	100	15-08-07A	23-08-07A															
G1461700	GH14 Grassing Fairway & Tee (Sod)	10	0	100	20-08-07A	23-08-07A															
G1461720	GH14 Grassing Fairway & Tee (Sprig)	4	0	100	23-08-07A	27-08-07A															
G1461740	GH14 Bunker 1 nr - Subsoil, Drainage & Sand	3	3	0	01-11-07*	03-11-07	-8														
G1461800	GH14 Grass Establishment	28	4	90	28-08-07A	24-09-07	0														
G1461900	GH14 Grass Grow In	56	56	0	25-09-07	19-11-07	0														
Construction of Golf Course Hole No.15																					
GH 15: Construction of Golf Course																					
G1561740	GH15 Bunkers 2 nrs - Subsoil, Drainage & Sand	4	4	0	01-11-07*	05-11-07	-9														
G1561800	GH15 Grass Establishment	28	0	100	08-08-07A	04-09-07A															
G1561900	GH15 Grass Grow In	56	41	20	05-09-07A	31-10-07	0														
S500920	GH15 Halfway House E&M & Finishing	21	5	80	13-08-07A	27-09-07	22														
Tank No.15 and Pump House No.15																					
T & PH 15: E&M Works																					
G1590700	E&M installation and commissioning	12	6	50	13-08-07A	28-09-07	128														
G1590800	Energizing low flow pump house to GH15	6	6	0	21-09-07	28-09-07	128														
G1590900	PH15 Commencement of Operation	0	0	0	29-09-07		128														
Construction of Bridge 15																					
Bridge No.15: Bridge Deck																					
G1581300	Railing	2	2	0	27-09-07	28-09-07	17														

Start Date 28-12-05
Finish Date 27-03-08
Data Date 21-09-07
Run Date 05-10-07 15:04

Early Bar
 Progress Bar
 Critical Activity

KS21 Sheet 6 of 9
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

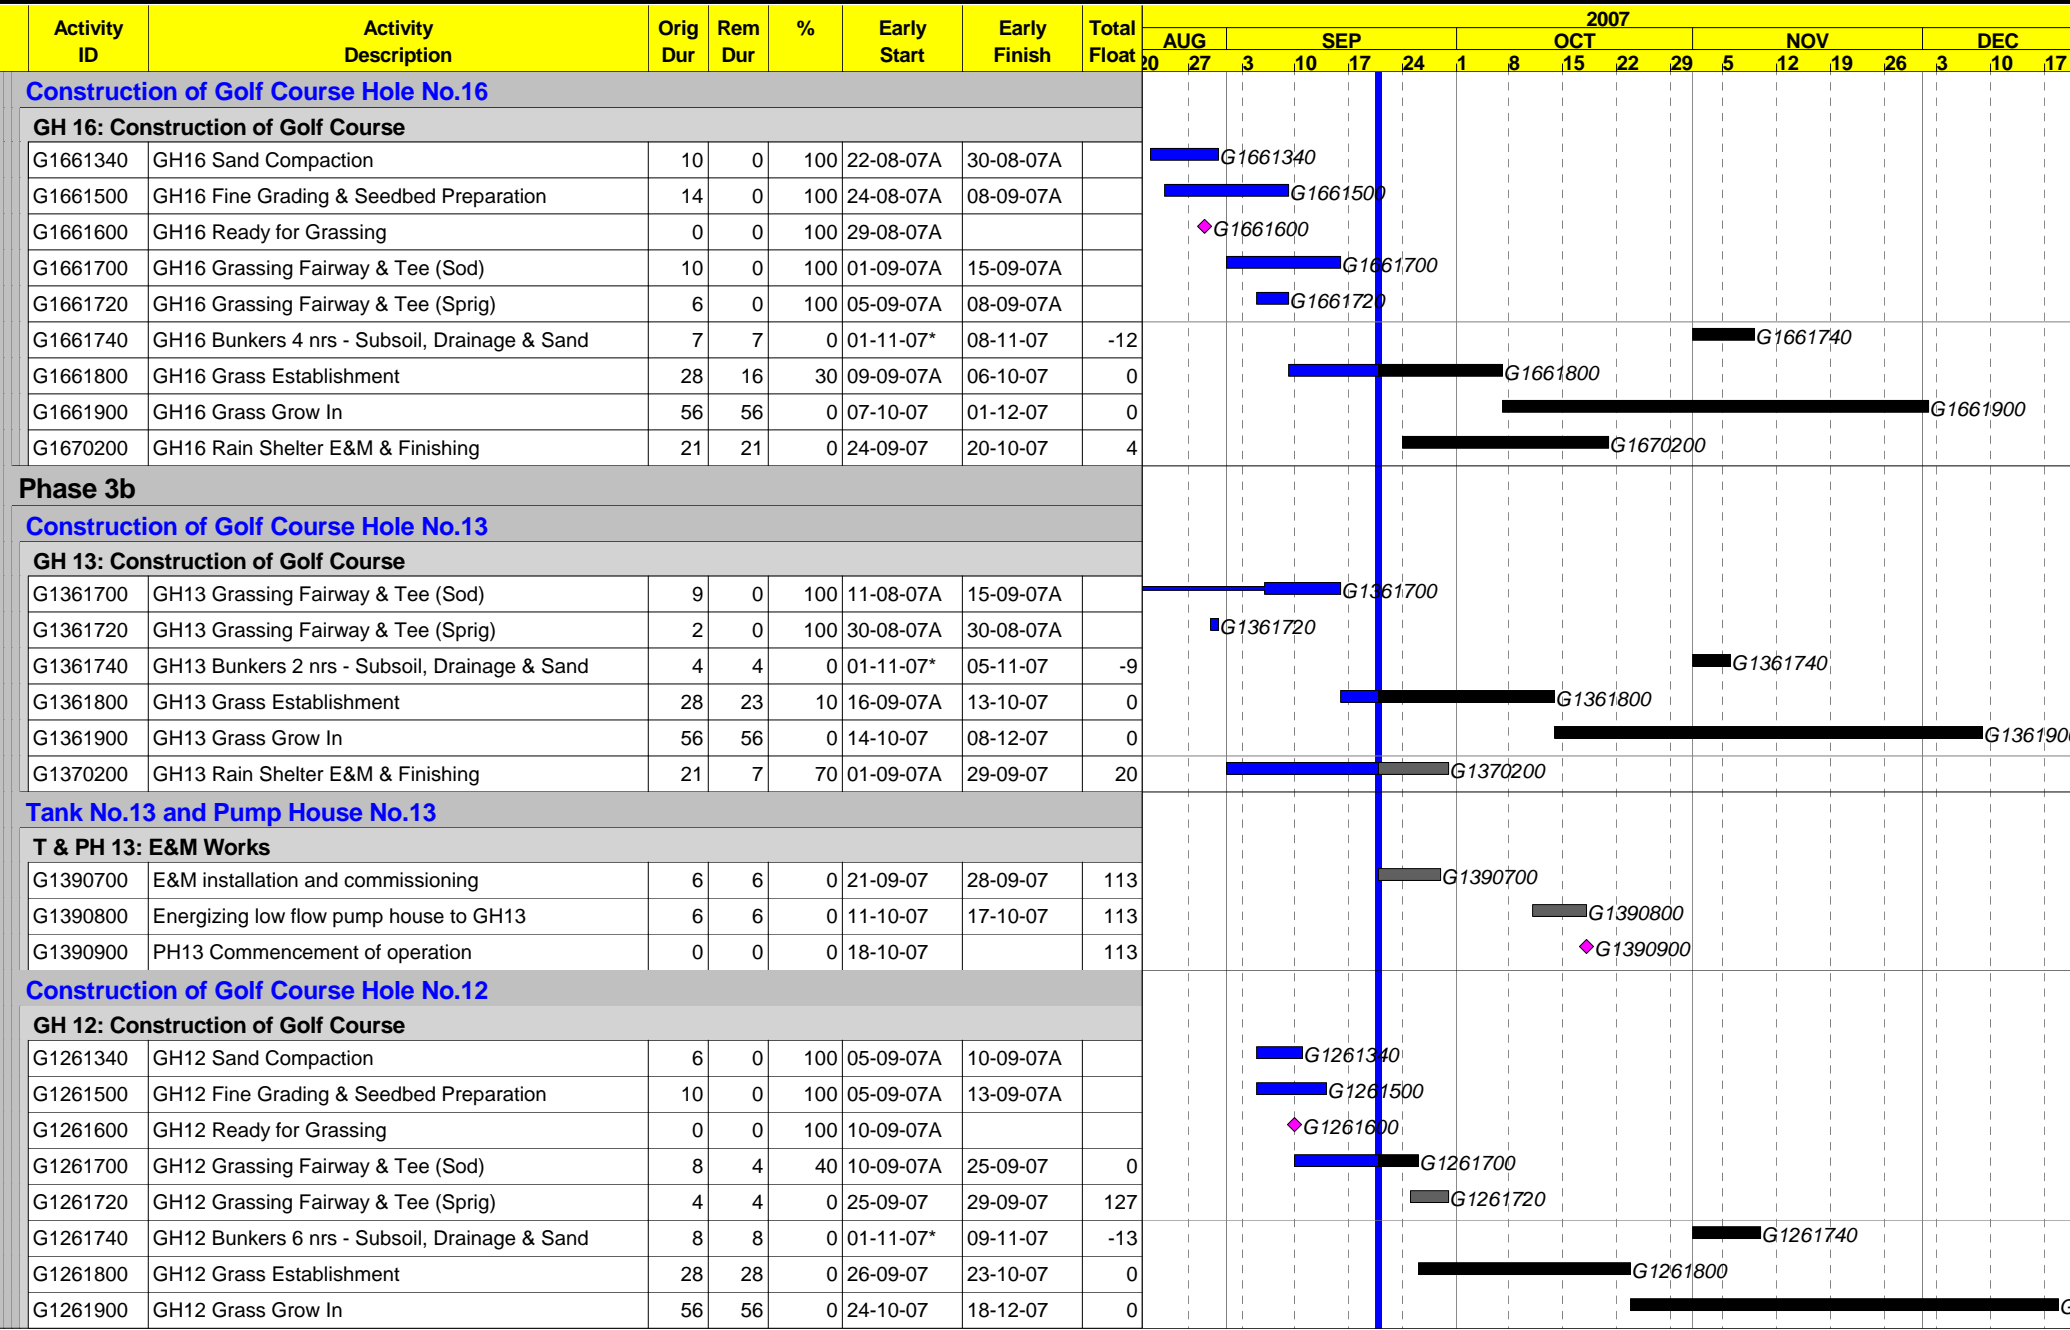

Start Date 28-12-05
 Finish Date 27-03-08
 Data Date 21-09-07
 Run Date 05-10-07 15:04




■ Early Bar
 ■ Progress Bar
 ■ Critical Activity

KS21
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

Activity ID	Activity Description	Orig Dur	Rem Dur	%	Early Start	Early Finish	Total Float	2007																		
								AUG	SEP			OCT			NOV			DEC								
								20	27	3	10	17	24	1	8	15	22	29	5	12	19	26	3	10	17	
G1270200	GH12 Rain Shelter E&M & Finishing	21	10	30	10-09-07A	04-10-07	4																			
Tank No.12 and Pump House No.12																										
T & PH 12: E&M Works																										
G1290700	E&M installation and commissioning	12	12	0	21-09-07*	06-10-07	101																			
G1290800	Energizing low flow pump house to GH12	6	6	0	26-10-07	01-11-07	101																			
G1290900	PH12 Commencement of operation	0	0	0	02-11-07		101																			
Construction of Golf Course Hole No.11																										
GH 11: Construction of Golf Course																										
G1161730	GH11 Grassing Green Complex stg2 (Sprig)	1	0	100	21-08-07A	22-08-07A																				
G1161740	GH11 Bunkers 2 nrs - Subsoil, Drainage & Sand	5	5	0	01-11-07*	06-11-07	-10																			
G1161800	GH11 Grass Establishment	28	0	100	23-08-07A	19-09-07A																				
G1161900	GH11 Grass Grow In	56	55	0	20-09-07A	14-11-07	0																			
Tank No.11 and Pump House No.11																										
T & PH 11: E&M Works																										
G1190700	E&M installation and commissioning	12	12	0	21-09-07*	06-10-07	116																			
G1190800	Energizing low flow pump house to GH11	6	6	0	08-10-07	13-10-07	116																			
G1190900	PH11 Commencement of operation	0	0	0	15-10-07		116																			
S10 Golf Course Area																										
Existing Admin. Building																										
S10 Golf Course Area																										
S1011000	S10 stg1 subsoil drain installation	3	0	100	02-08-07A	25-08-07A																				
S1011100	S10 stg1 sand capping	4	0	100	07-08-07A	27-08-07A																				
S1011200	S10 stg1 Turfing for Tees	2	0	100	19-09-07A	21-09-07A																				
S1020600	S10 stg2 Engineer's Design for Drainage	6	0	100	02-08-07A	23-08-07A																				
S1020700	S10 stg2 Storm Drainage	6	0	100	24-08-07A	31-08-07A																				
S1020800	S10 stg2 Feature Shaping & rock picking	6	0	100	01-09-07A	03-09-07A																				
S1020900	S10 stg2 Irrigation Laterals	4	0	100	13-09-07A	15-09-07A																				
S1021000	S10 stg2 Subsoil Drain Installation	4	0	100	17-09-07A	17-09-07A																				
S1021100	S10 stg2 Sand Capping	6	6	0	21-09-07	28-09-07	17																			
S1021200	S10 stg2 Turfing for Green & surrounding Area	4	4	0	29-09-07	04-10-07	17																			
S1030200	S10 & GPA Halfway House E&M & Finishing	21	7	90	20-08-07A	29-09-07	127																			
General Works																										
G9901200	Grassing Green for GH11-13-14-15	8	0	100	18-08-07A	15-09-07A																				

Start Date 28-12-05
 Finish Date 27-03-08
 Data Date 21-09-07
 Run Date 05-10-07 15:04

 Early Bar
 Progress Bar
 Critical Activity

KS21 Sheet 8 of 9
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

Activity ID	Activity Description	Orig Dur	Rem Dur	%	Early Start	Early Finish	Total Float	2007																		
								AUG	SEP			OCT			NOV			DEC								
								20	27	3	10	17	24	1	8	15	22	29	5	12	19	26	3	10	17	
G9901300	Grassing Green for GH09-10-12-16	8	0	100	01-09-07A	21-09-07A																				
G9901400	Grassing Green for GH01-02-17-18	8	8	0	13-12-07	21-12-07	-49																			
Construction of Golf Course Hole No.2																										
G0260120	GH02 Rock Breaking for Storm Drainage	18	17	10	19-09-07A	16-10-07	-52																			
Construction of Bridge 5																										
G0571500	Railing	2	2	0	24-09-07*	25-09-07	17																			


Start Date 28-12-05
 Finish Date 27-03-08
 Data Date 21-09-07
 Run Date 05-10-07 15:04

 Early Bar
 Progress Bar
 Critical Activity

KS21 Sheet 9 of 9
China Harbour Engineering Company (Group)
The Jockey Club Kau Sai Chau Public Golf Course
3 month rolling programme
Upto Date : 21-09-07

Date	Revision	Checked	Approved
28-12-05	1st rolling	Tim	

FIGURES

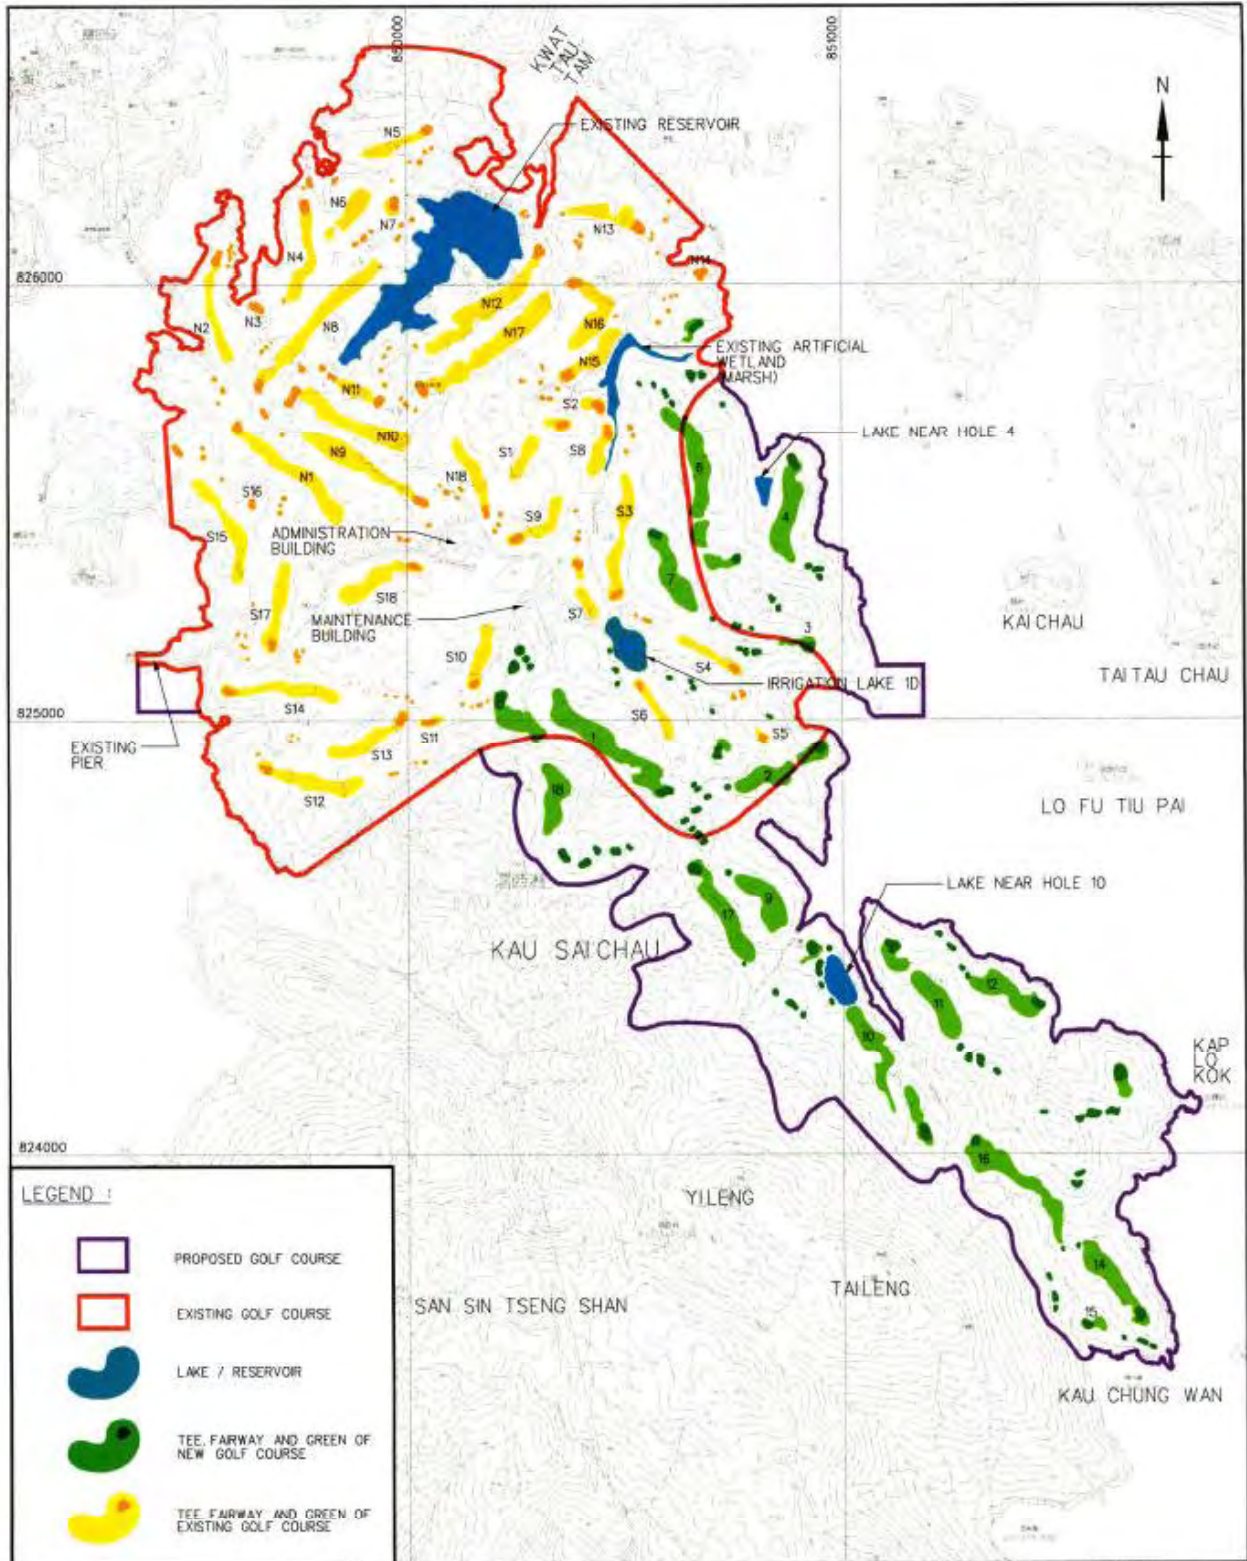

The Hong Kong Jockey Club


BLACK & VEATCH HONG KONG LIMITED
 博威工程顧問有限公司



PROPOSED EXTENSION OF PUBLIC GOLF COURSE AT KAU SAI CHAU, SAI KUNG

PROPOSED 18-HOLE THIRD GOLF COURSE (MASTER LAYOUT PLAN)

Figure No.	Revision
1.1	-
Reference	File Name
-	3822100201-2.1.DGN
Prepared	Checked
ET	JW
Date	Scale
MAY 2005	1:15000 (A4)

Figure 1.2
Project Organisation and Lines of Communication

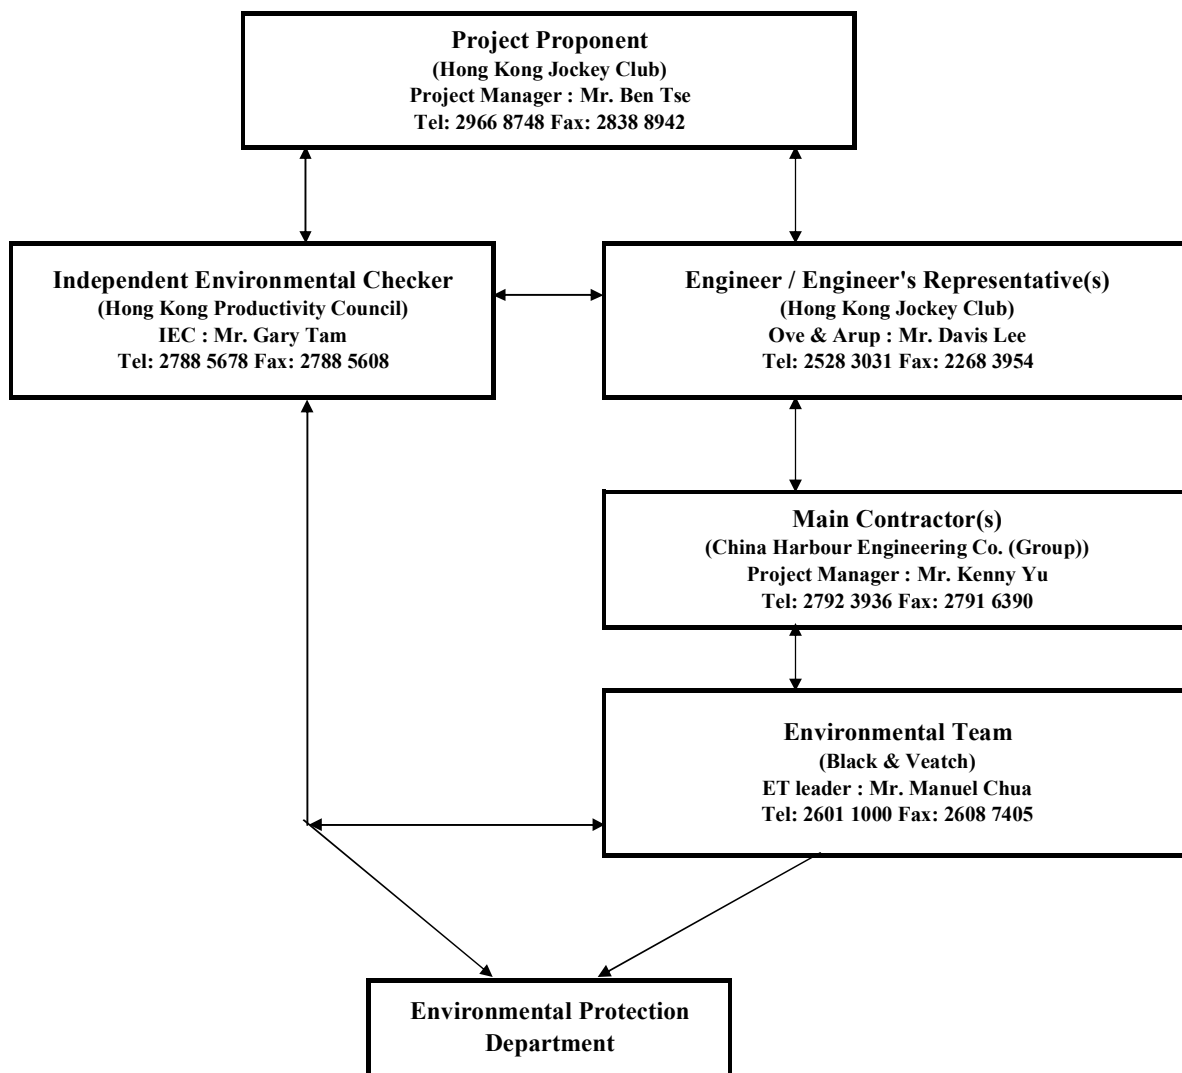

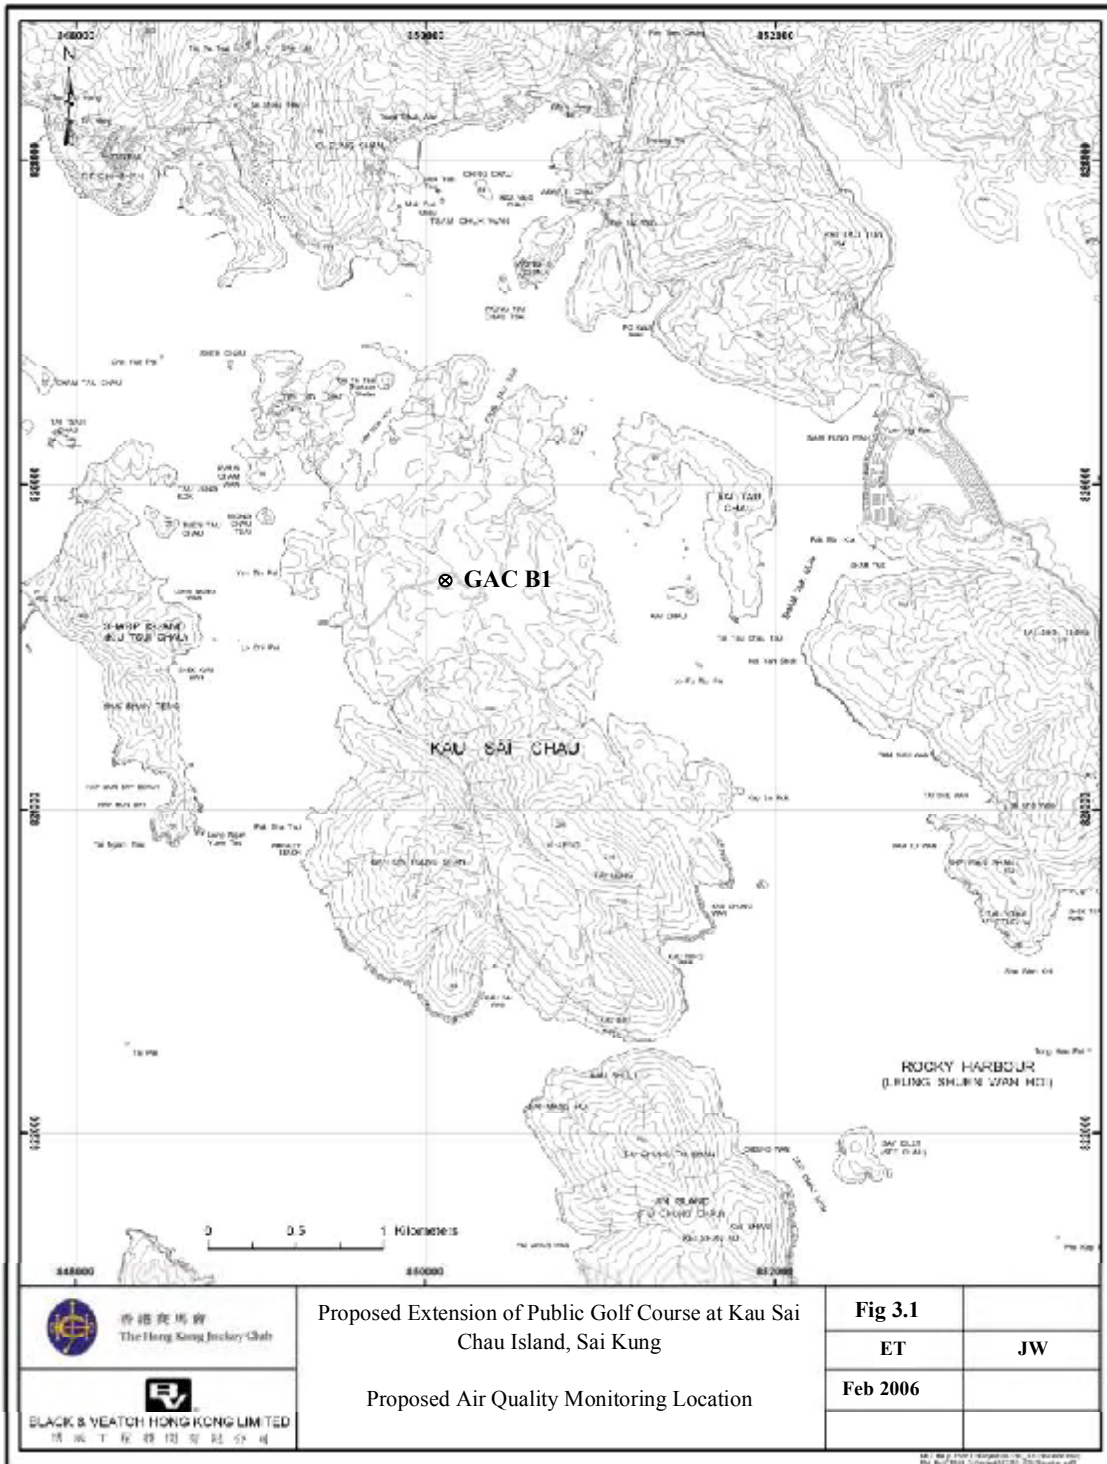

香港賽馬會
The Hong Kong Jockey Club



BLACK & VEATCH HONG KONG LIMITED
黑 威 士 德 有 限 公 司

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung

Proposed Air Quality Monitoring Location


Fig 3.1

ET

JW

Feb 2006

Small text at the bottom right corner of the page, likely a reference or copyright notice.

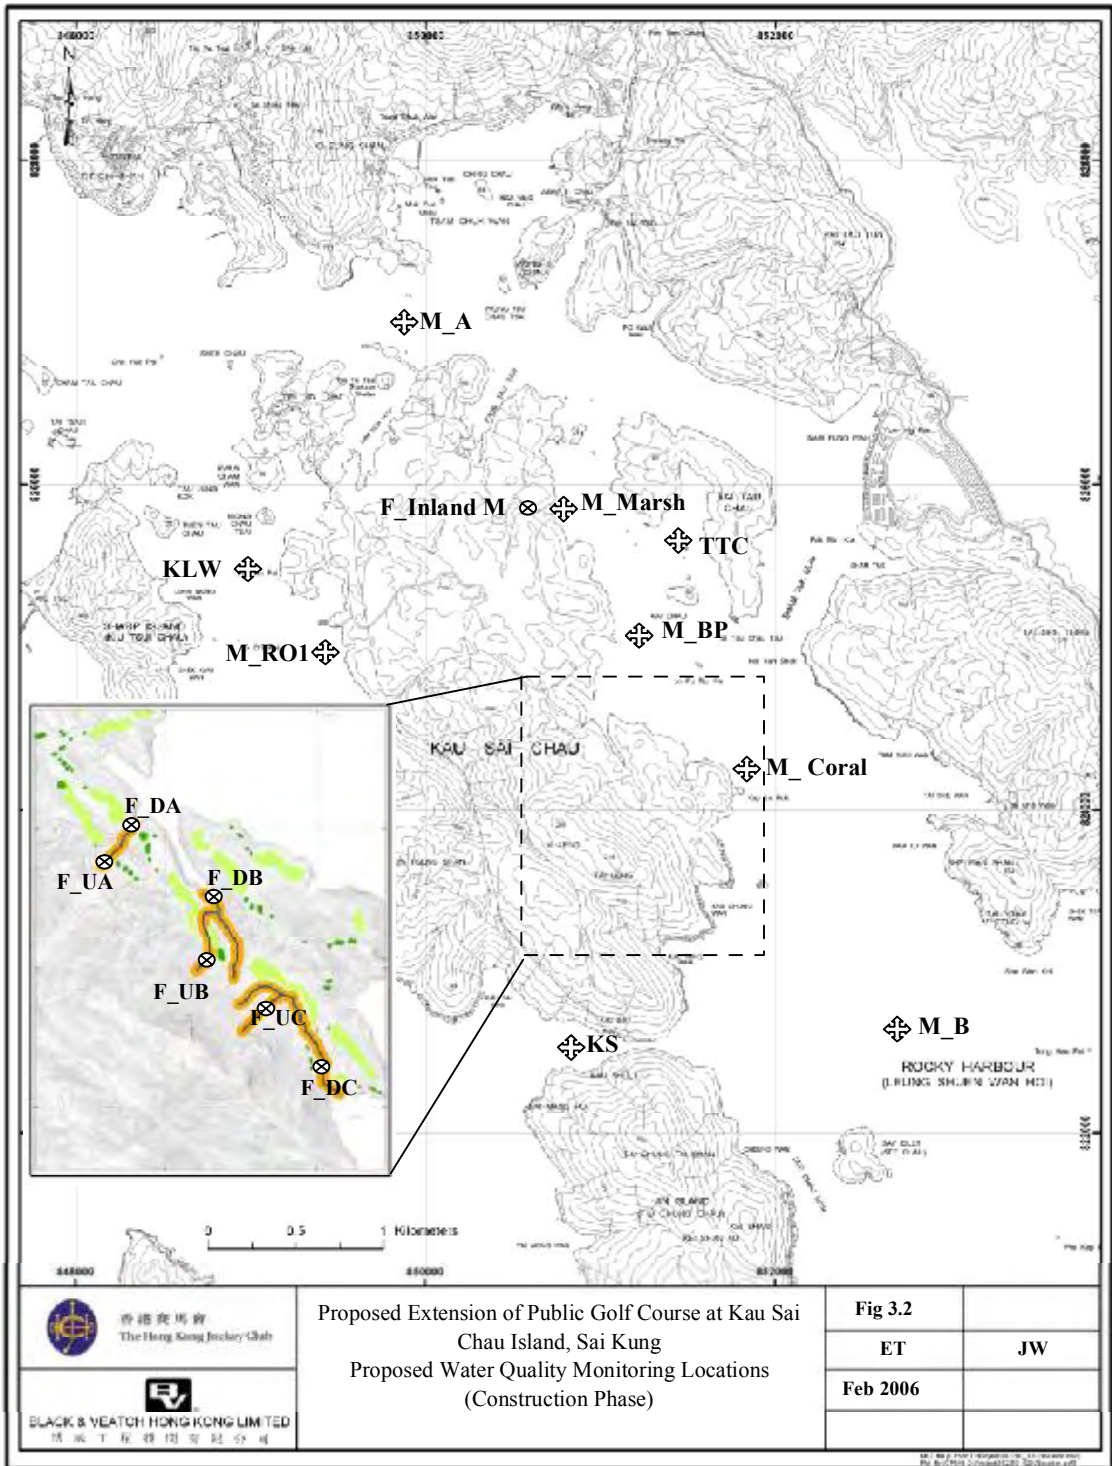



 香港賽馬會
 The Hong Kong Jockey Club

 BLACK & VEATCH HONG KONG LIMITED
 黑 威 士 德 有 限 公 司

Proposed Extension of Public Golf Course at Kau Sai
 Chau Island, Sai Kung
 Proposed Water Quality Monitoring Locations
 (Construction Phase)

Fig 3.2	
ET	JW
Feb 2006	

1:50,000
 1:50,000
 1:50,000

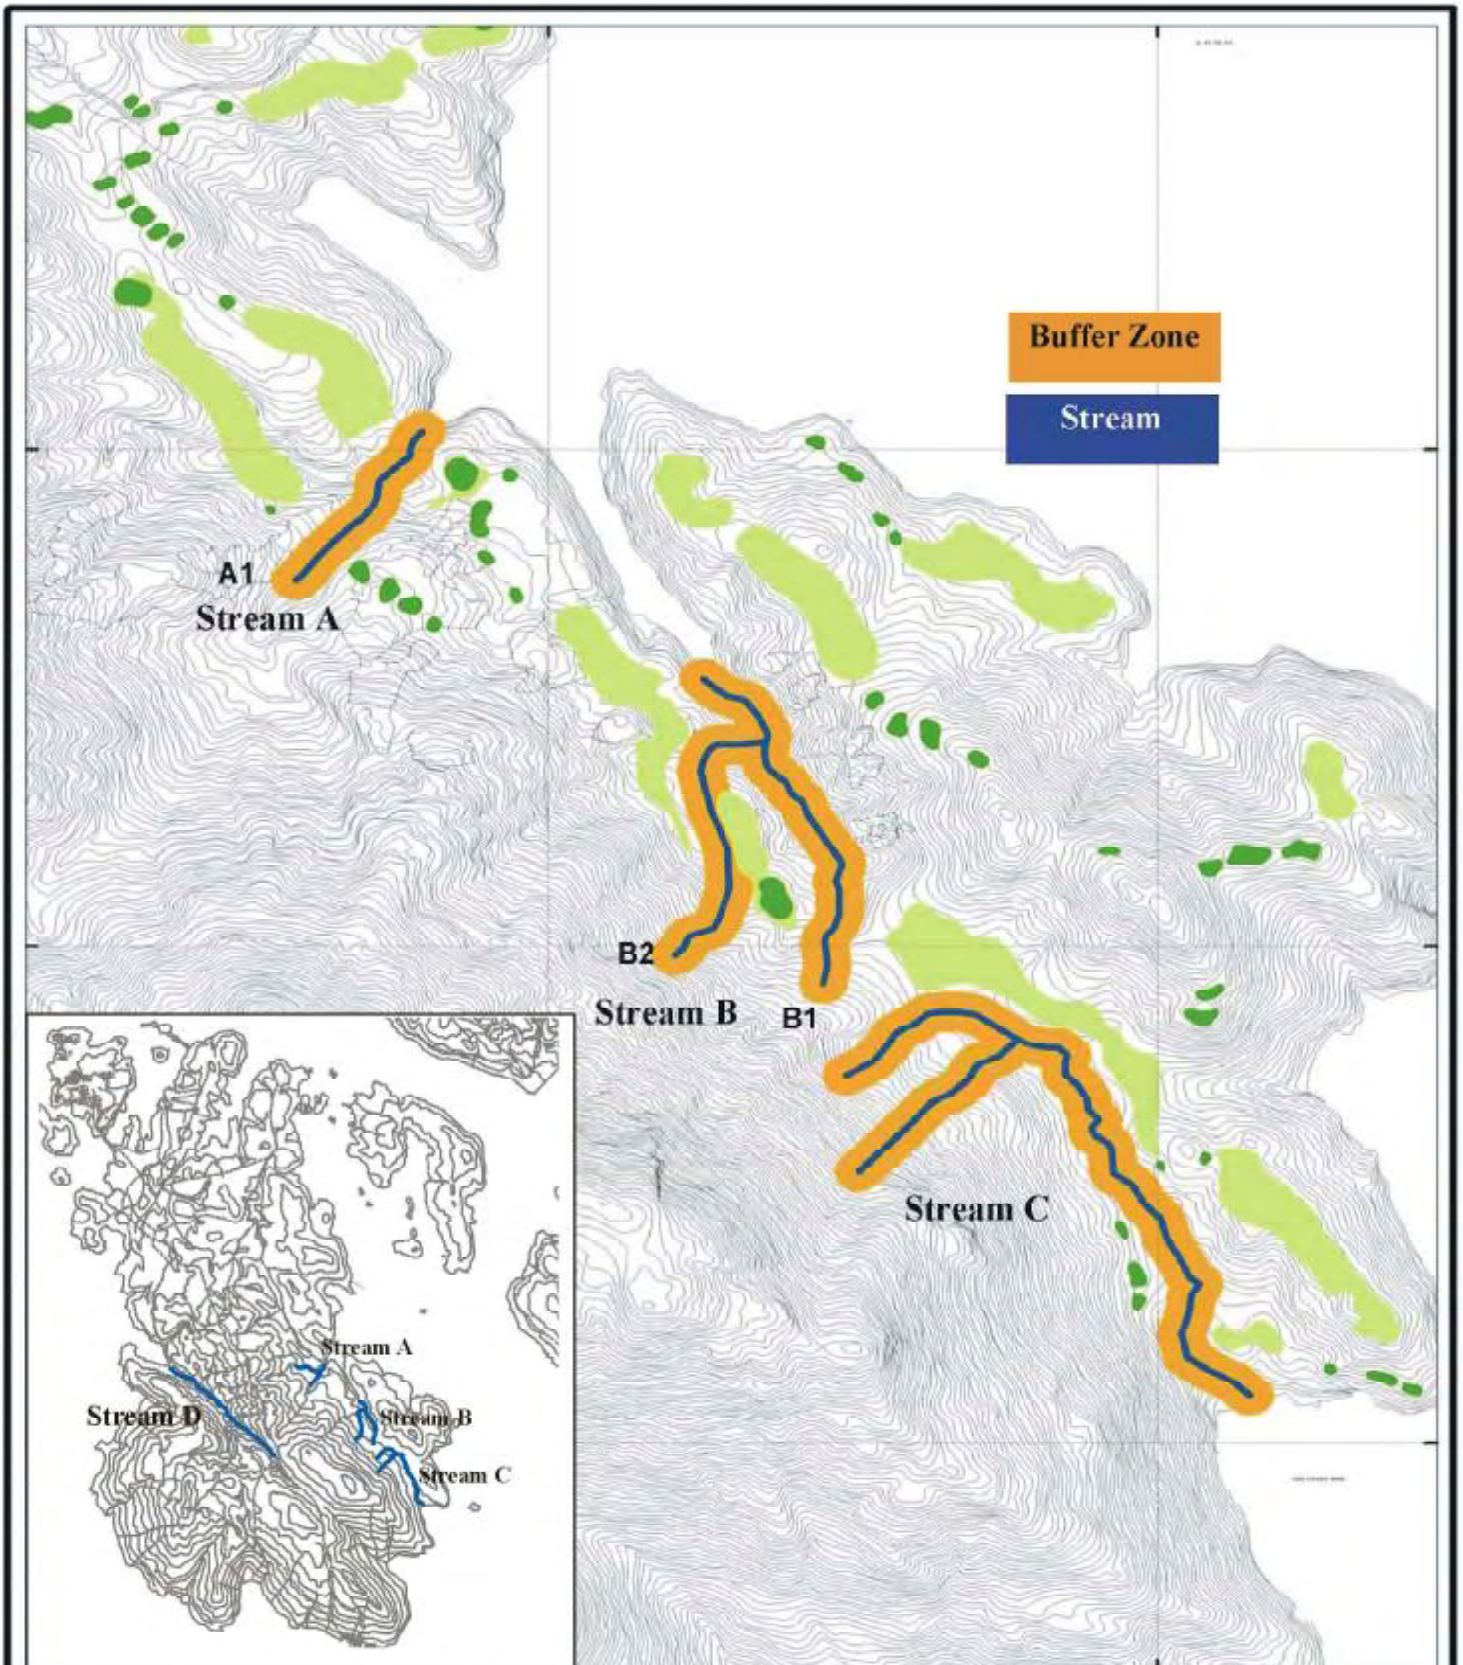

Buffer Zone

Stream

A1
Stream A

B2
Stream B

B1

Stream C

Stream A

Stream B

Stream C

Stream D


 香港賽馬會
 The Hong Kong Jockey Club


BLACK & VEATCH HONG KONG LIMITED
 博威工程顧問有限公司

Proposed Extension of Public Golf Course at Kau Sai
 Chau Island, Sai Kung
 Proposed Ecological Monitoring Location
 (Streams Buffer Zone)

Fig 3.3	
ET	JW
July 2005	

Map No. J/27/05 (2) (Proposed) 2005 Location (m-4)
 Plot No. J/47/05 (2) (Proposed) 2005 Location (m-4)

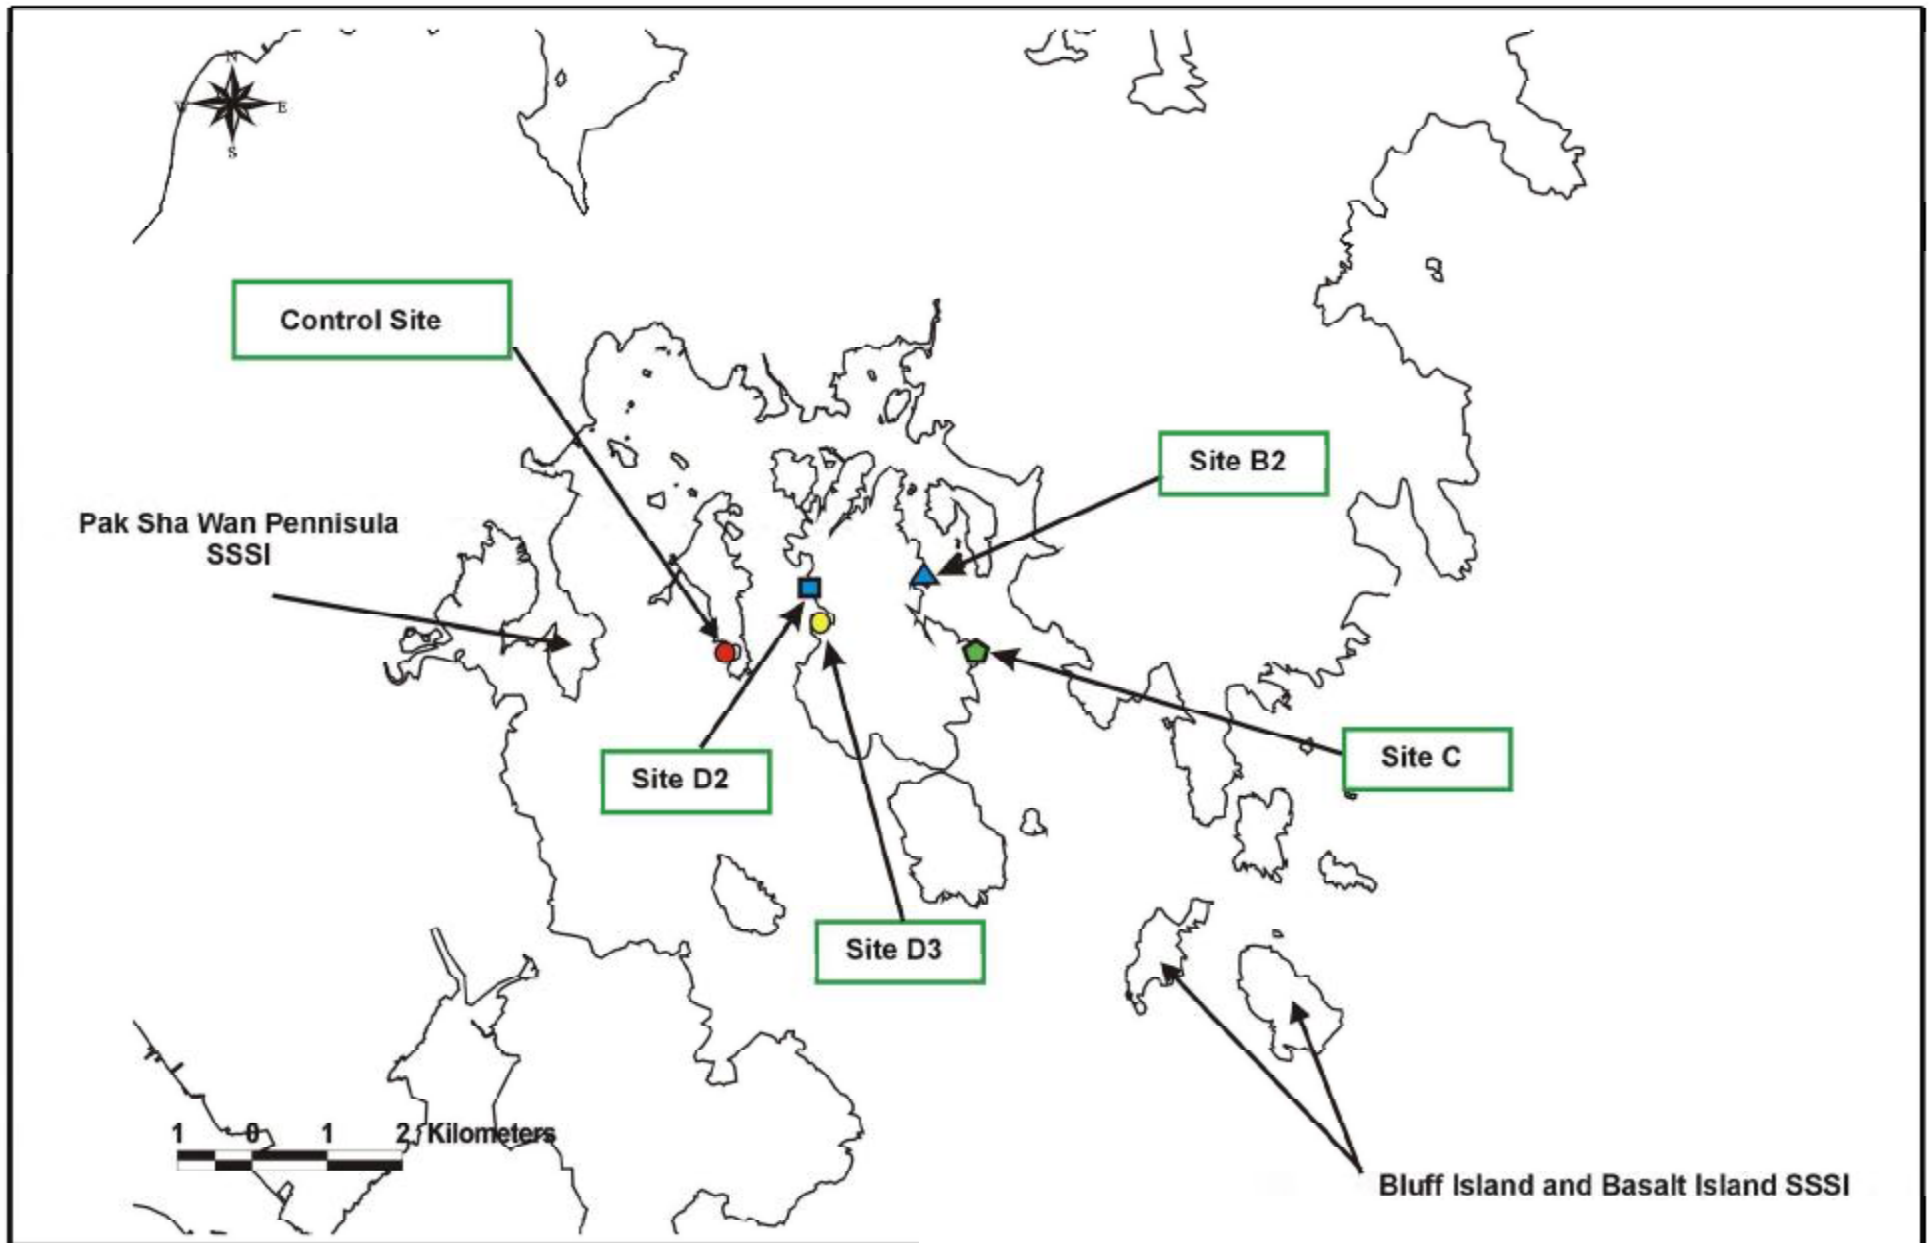


Figure 3.4a Site C, Site B2, Site D2 and a Control Site near the AFCD's Coral Buoy at Sharp Island


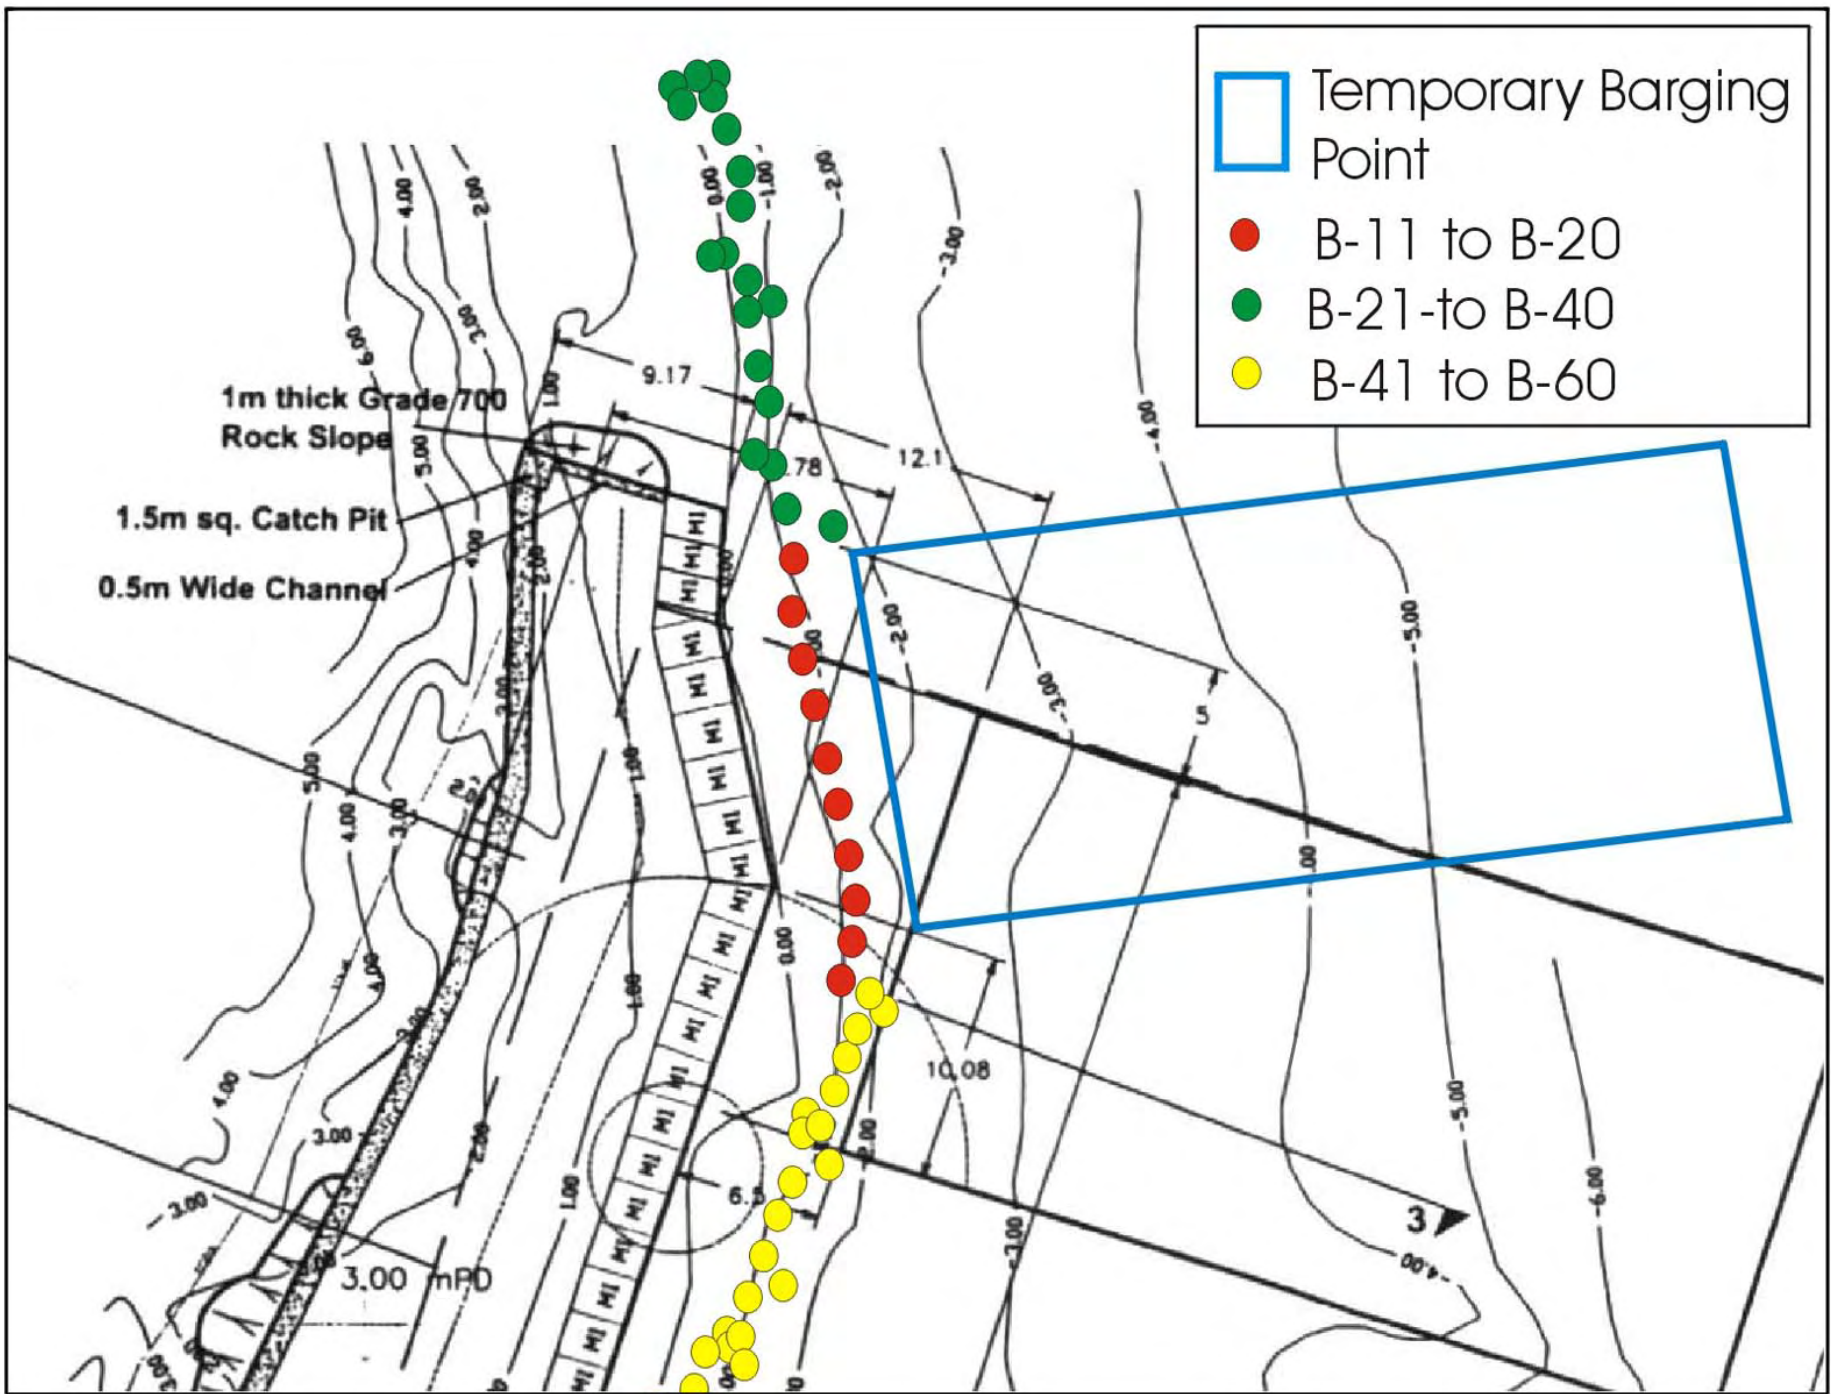


Figure 3.4b
Indicative map of additional tagged corals at Site B2



香港賽馬會
The Hong Kong Jockey Club

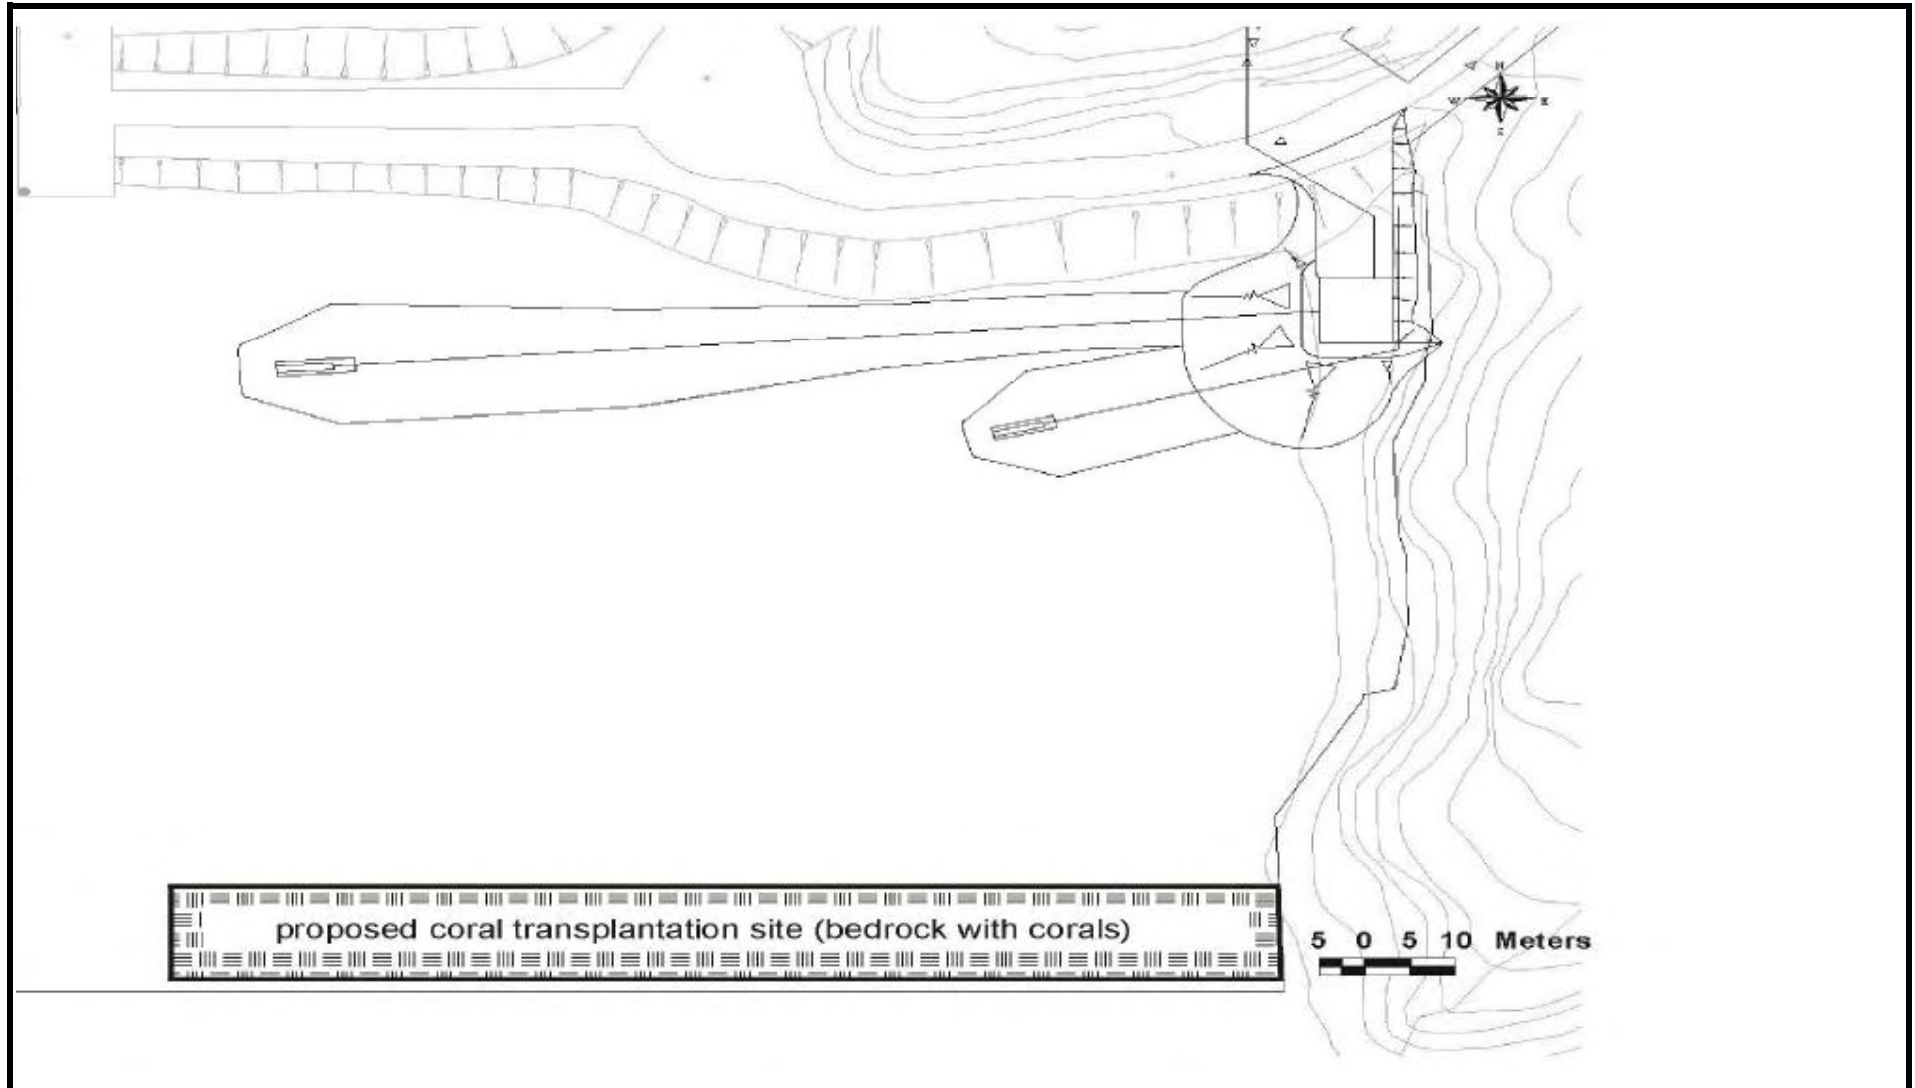

BLACK & VEATCH HONG KONG LIMITED
博威工程顧問有限公司

Proposed Extension of Public Golf Course at Kan Sai Chau Island, Sai Kung

Location of proposed coral transplantation site (bedrock with corals)

Fig 3.5

Prepared

ET

Date

Checked

JW

Jun-05

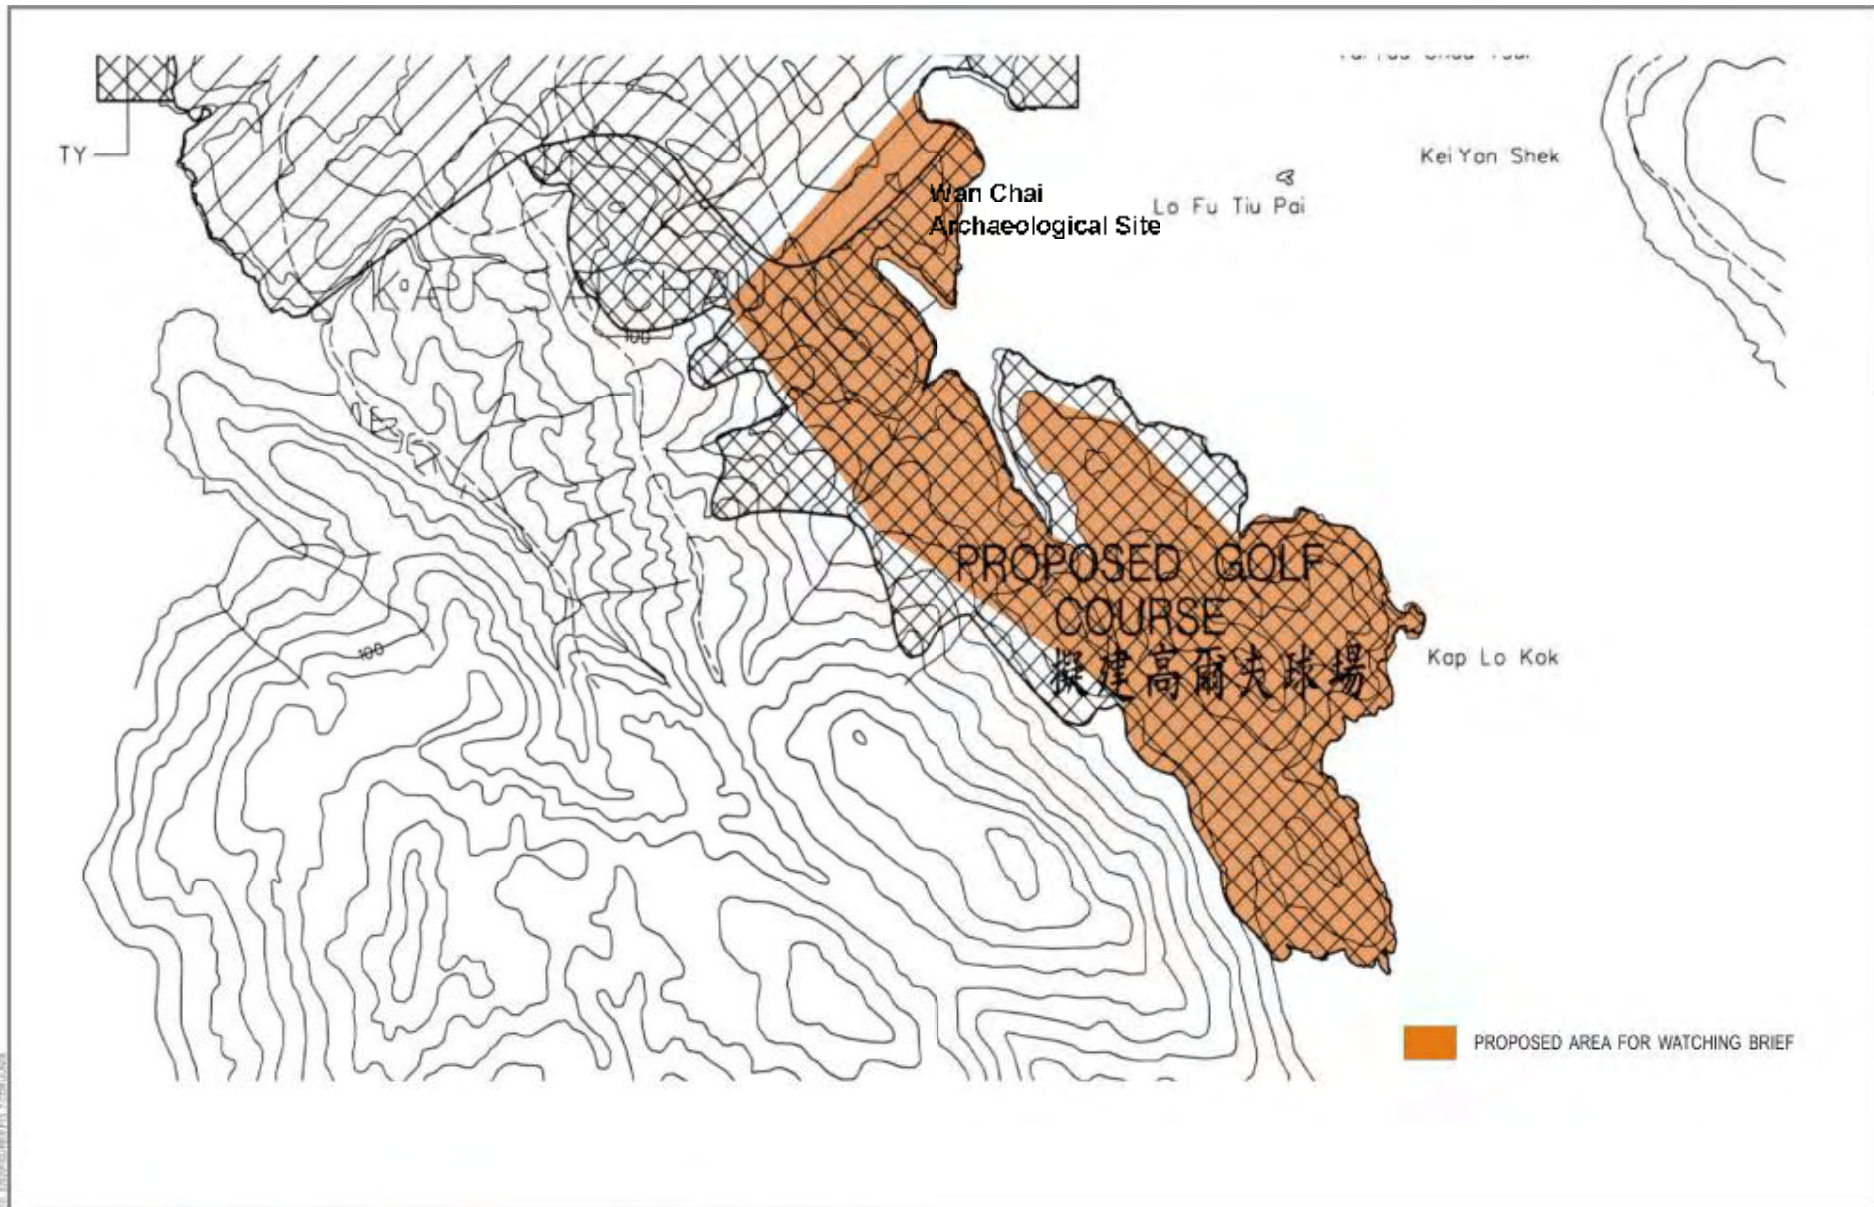



FIGURE 3.6 PRELIMINARY ENVIRONMENTAL MONITORING


BLACK & VEATCH HONG KONG LIMITED
 博威工程顧問有限公司


Archaeological Assessments
22, 1/F, Po Shek Mansions,
 14-18 Po Shek Rd., HK.
 Tel: (852) 3221 4715

Hong Kong Jockey Club
 Kau Sai Chau Public Golf Course New Development

Figure 3.6
Map Showing the Extent of the Area to monitored
under the Watching Brief

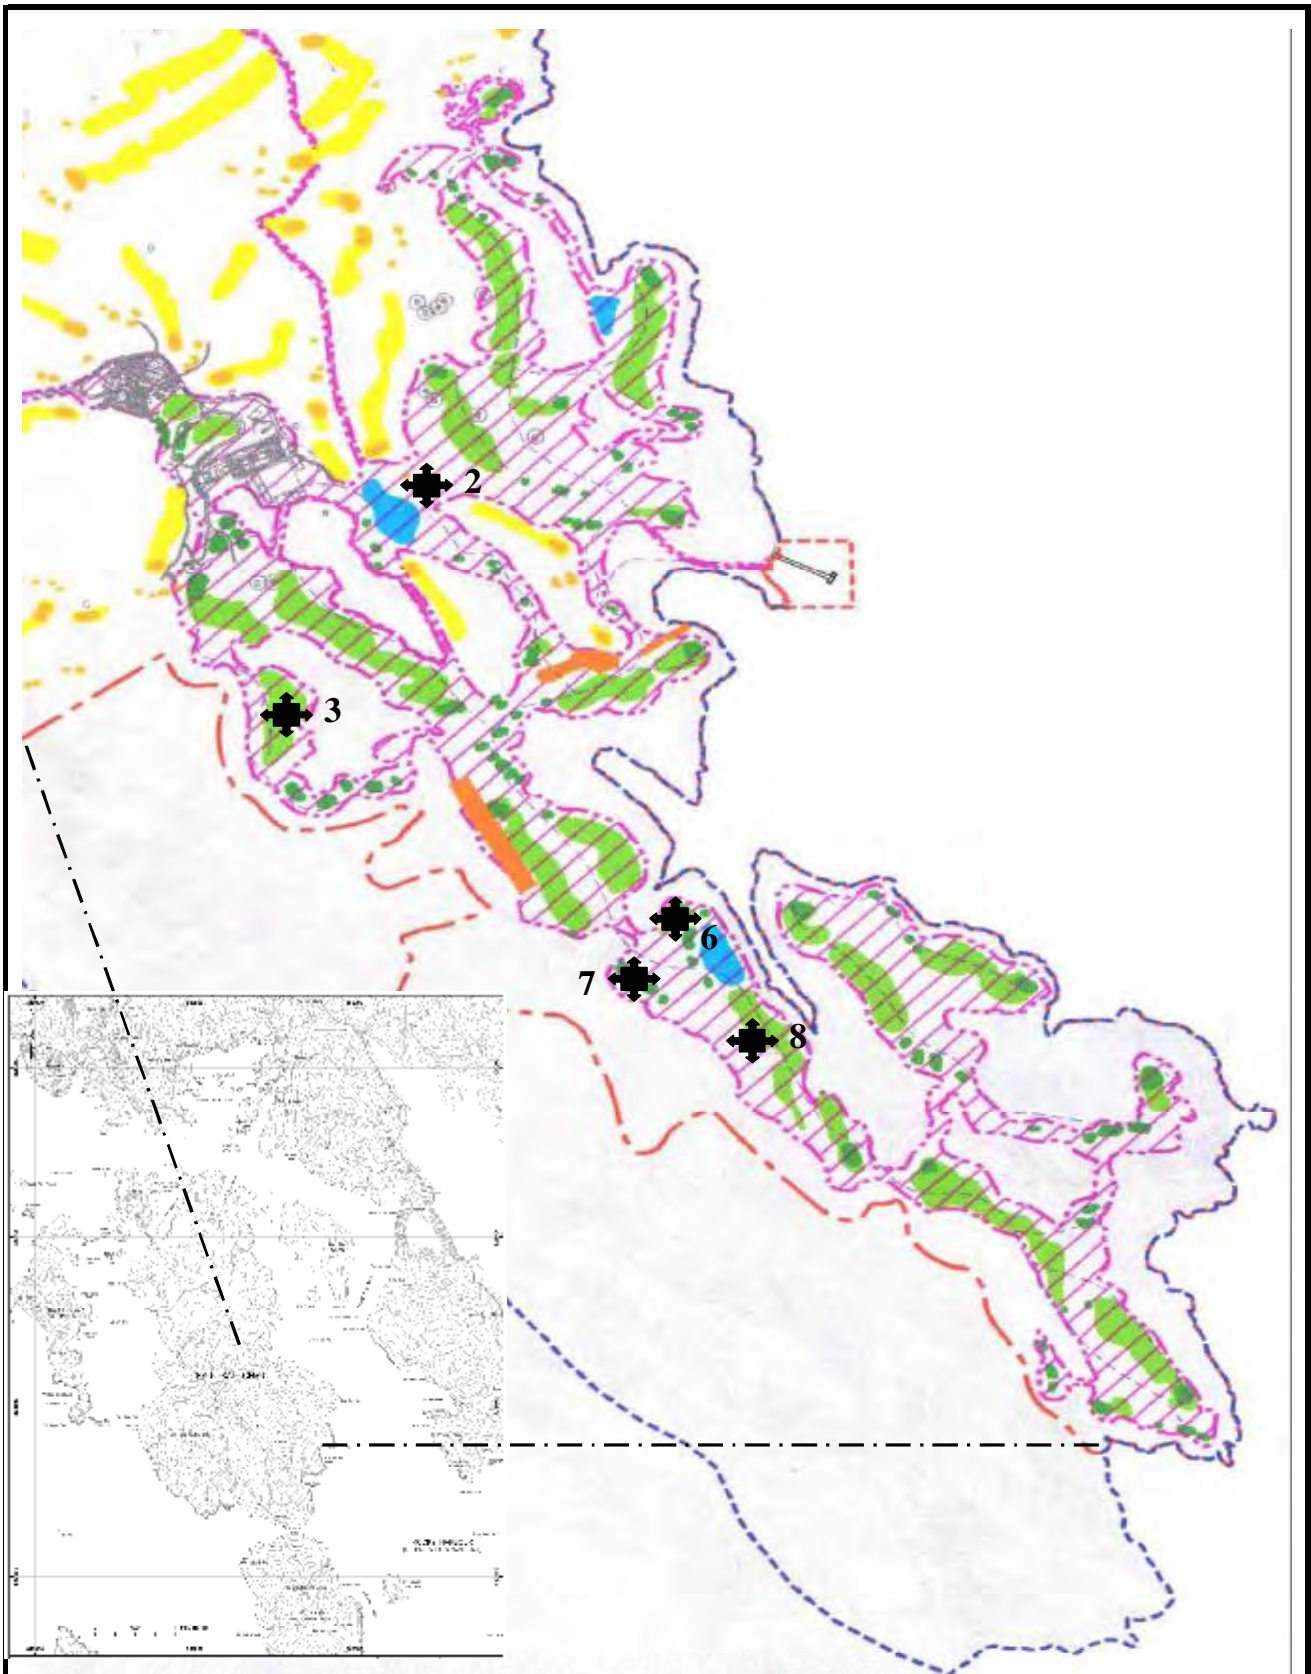

 <p>香港賽馬會 The Hong Kong Jockey Club</p>
 <p>BLACK & VEATCH HONG KONG LIMITED 博威工程顧問有限公司</p>

Proposed Extension of Public Golf Course at Kau Sai Chau Island, Sai Kung

Sampling location for land contamination

Fig 3.7	
Prepared ET	Checked JW
Date Jun-05	