Dragages-Nishimatsu Joint Venture

Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel

Monthly EM&A Report

February 2011 (version 2.0)

Certified By

(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

CINOTECH CONSULTANTS LTD

Room 1710, Technology Park, 18 On Lai Street, Shatin, NT, Hong Kong Tel: (852) 2151 2083 Fax: (852) 3107 1388

Email: info@cinotech.com.hk

TABLE OF CONTENTS

EX	ECUTIVE SUMMARY	1
	Introduction Environmental Monitoring Works Environmental Licenses and Permits Key Information in the Reporting Month	1 6
1.	INTRODUCTION	8
	Background	8 9
2.	AIR QUALITY	13
	Monitoring Requirements Monitoring Locations Monitoring Equipment Monitoring Parameters, Frequency and Duration Monitoring Methodology and QA/QC Procedure Results and Observations	13 13 13 14
3.	NOISE	18
	Airborne Construction Noise Monitoring Monitoring Requirements Monitoring Locations Monitoring Equipment Monitoring Parameters, Frequency and Duration Monitoring Methodology and QA/QC Procedures Maintenance and Calibration Results and Observations Ground Borne Construction Noise Monitoring Monitoring Requirements Monitoring Locations Monitoring Equipment Monitoring Parameters, Frequency and Duration Results and Observations	18 18 19 19 20 30 30 30 30 31
4.	WATER QUALITY	33
	Monitoring Requirements Monitoring Locations Results and Observations Underground water level	33 33
5.	ENVIRONMENTAL AUDIT	35
	Site Audits Review of Environmental Monitoring Procedures Status of Environmental Licensing and Permitting Status of Waste Management Implementation Status of Environmental Mitigation Measures	35 35 35

	Non-co	mpliance Recorded during Site Inspections	.41
		ry of Mitigation Measures Implemented	
		entation Status of Event Action Plans	
		ry of Complaint, Warning, Notification of any Summons and Successful	
		ition	. 45
6.	FUTU	RE KEY ISSUES	. 46
	Key Iss	ues for the Coming Month	. 46
		action Program for the Next Month	
7.	CONC	LUSIONS AND RECOMMENDATIONS	. 48
	Conclu	sions	. 48
	Recom	mendations	. 48
T TO	T OF T	A DI EG	
LIS	I OF I	ABLES	
Tab	le I	Summary Table for Non-compliance Recorded in the Reporting Month	
Tab	le II	Summary Table for Key Information in the Reporting Month	
Tab	le 1.1	Key Project Contacts	
Tab	le 1.2	Construction programme showing the inter-relationship with environmental	
		protection/mitigation measures	
	le 2.1	Locations for Air Quality Monitoring	
Tab	le 2.2	Air Quality Monitoring Equipment	
Tab	le 2.3	Impact Dust Monitoring Parameters, Frequency and Duration	
Tab	le 2.4	Summary Table of Air Quality Monitoring Results during the reporting month	
Tab	le 3.1	Noise Monitoring Stations	
Tab	le 3.2	Noise Monitoring Equipment	
Tab	le 3.3	Noise Monitoring Parameters, Frequency and Duration	
Tab	le 3.4	Baseline Noise Level and Noise Limit Level for Monitoring Stations	
Tab	le 3.5	Summary Table of Noise Monitoring Results during the reporting month	
Tab	le 3.6	Ground Borne Noise Monitoring Parameters, Frequency and Duration	
Tab	le 3.7	Construction Ground Borne Noise Standards	
Tab	le 3.8	Summary Table of Ground Borne Noise Monitoring Results during the	
		Reporting Month	
Tab	le 4.1	Locations for Water Quality Monitoring	
Tab	le 4.2	Ground Water Level Monitoring Data	
Tab	le 5.1	Summary of Environmental Licensing and Permit Status	
Tab	le 5.2	Observations and Recommendations of Site Inspections	

LIST OF FIGURES

Figure 1.1	Layout Plan of the Project Site
Figure 2.1	ET's Organization Chart
Figure 3.1a	Locations of Air Quality and Construction Noise Monitoring Stations at
	Eastern Portal
Figure 3.1b	Locations of Air Quality and Construction Noise Monitoring Stations at
	Western Portal
Figure 3.1c	Locations of Construction Noise Monitoring Stations at Intake E7
Figure 3.1d	Locations of Construction Noise Monitoring Stations at Intake PFLR1
Figure 3.1e	Locations of Construction Noise Monitoring Stations at Intake W0
Figure 3.1f	Locations of Construction Noise Monitoring Stations at Intake RR1
Figure 3.1g	Locations of Construction Noise Monitoring Stations at Intake W5
Figure 3.1h	Locations of Construction Noise Monitoring Stations at Intake E5A
Figure 3.1i	Locations of Construction Noise Monitoring Stations at Intake THR2
Figure 3.1j	Locations of Construction Noise Monitoring Stations at Intake P5
Figure 3.1k	Locations of Construction Noise Monitoring Stations at Intake W8
Figure 3.11	Locations of Construction Noise Monitoring Stations at Intake DG1
Figure 3.1m	Locations of Construction Noise Monitoring Stations at Intake MA14
Figure 3.1n	Locations of Construction Noise Monitoring Stations at Intake BR6
Figure 3.1o	Location of Construction Ground Borne Noise Monitoring Station
Figure 4.1a-b	Locations of Water Quality Monitoring Stations
Figure 4.2a-e	Location of Ground Water Level Monitoring Stations

LIST OF APPENDICES

A	Action and Limit Levels for Air Quality, Noise and Water Quailty
В	Copies of Calibration Certificates
C	Wind Data
D	Environmental Monitoring Schedules
E	1-hour TSP Monitoring Results, Graphical Presentations
F	24-hour TSP Monitoring Results, Graphical Presentations
G	Noise Monitoring Results and Graphical Presentations
Н	Summary of Exceedance
I	Site Audit Summary
J	Environmental Mitigation Implementation Schedule (EMIS)
K	Event Action Plans
L	Complaint Logs
M	Construction Programme
N	Waste Generated Ouantity

LIST OF ANNEX

I	Review Report on Handling & Delivery Of Excavation Materials at The
	Western Portal
II	Proposal of Two Blasts Per Day in Western Adits

EXECUTIVE SUMMARY

Introduction

- 1. This is the 35th Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the "Drainage Improvement in Northern Hong Kong Island Hong Kong West Drainage Tunnel" (the Project). This report documents the findings of EM&A Works conducted in February 2011.
- 2. The site activities undertaken in the reporting month included:
 - TBM excavation and adit excavation at Western Portal and Adit excavation Spoil Basin dismantle at Eastern Portal;
 - East TBM dismantling completed (except for main bearing transportation);
 - West TBM dismantling on-going;
 - RBM setup at intake DG1.
 - Dropshaft RBM. Reaming ongoing at Intake TP789 & GL1;
 - Dropshaft reaming completed at Intake TP5, TP4 on 11Feb11 and 01Feb11 respectively;
 - Cofferdam construction at Intakes W8, MA14, CR1;
 - Preparation works for RCD pump tests at intakes P5 and RR1;
 - Excavation of intake structure at Intakes E7, W10, W3, BR6, HR1, PFLR1, BR5, W1, W5, E5A, BR4, B2 and M3;
 - Permanent Intake structure works at SM1, HKU1, E5B, MBD2, MA15, and THR2;
 - Dropshaft Lining Works at MB16;
 - Slopeworks- soil nailing and installation of erosion control mat at Intake M3 complete;
 - Resumption of works at Intake W0. Adit lining on-going;
 - DDA submissions for Adit/Main Tunnel Intersection, Adits, Stilling Chambers and Turning Bays;
 - DDA submissions for temporary works, slope works and permanent works for Intake Structures;
 - DDA submissions for temporary and permanent works for Dropshafts;
 - Environmental impact monitoring; and
 - Casting of dropshaft precast rings.

Environmental Monitoring Works

- 3. Environmental monitoring for the Project was performed in accordance with the updated EM&A Manual and the monitoring results were checked and reviewed. Site Inspections/Audits were conducted once per week. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
- 4. Proposal for Temporary Suspension of Water Quality Monitoring Western Portal was submitted on 15th September 2009 and approved by EPD on 30th October 2009. Marine water quality monitoring was temporary suspended starting from 31st October 2009 until there is marine-based construction activities resumed at the Western Portal (i.e. March of 2011 tentatively.)

- 5. In order to assess the effectiveness of the implementation of water quality mitigation measures at Western Portal, site inspections/audits were conducted at least twice per week at Western Portal starting from November 2009.
- 6. Summary of the non-compliance of the reporting month is tabulated in Table I.

Table I Summary Table for Non-compliance Recorded in the Reporting Month

Parameter	No. of Exceedance		No. of Exceedance Due to the Project		Action
	Action Level	Limit Level	Action Level	Limit Level	Taken
Eastern Portal					
1-hr TSP	0	0	0	0	N/A
24-hr TSP	0	0	0	0	N/A
Noise	0	0	0	0	N/A
Western Porta	ıl				
1-hr TSP	0	0	0	0	N/A
24-hr TSP	0	0	0	0	N/A
Noise	1	0	1	0	N/A
Intake DG1					
Noise	0	0	0	0	N/A
Intake E5A					
Noise	0	0	0	0	N/A
Intake E7					
Noise	0	0	0	0	N/A
Intake MA14					
Noise	0	0	0	0	N/A
Intake PFLR1					
Noise	0	0	0	0	N/A
Intake W0					
Noise	0	0	0	0	N/A

Intake RR1							
Noise	0	0	0	0	N/A		
Intake W5							
Noise	0	0	0	0	N/A		
Intake P5							
Noise	0	0	0	0	N/A		
Intake W8	Intake W8						
Noise	0	0	0	0	N/A		
Intake BR6							
Noise	0	0	0	0	N/A		
Intake TP5							
Noise	0	0	0	0	N/A		
Intake GL1							
Noise	1	0	1	0	N/A		

Eastern Portal

1-hour TSP Monitoring

7. All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

24-hour TSP Monitoring

8. All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Construction Noise

9. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Western Portal

1-hour TSP Monitoring

10. All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

24-hour TSP Monitoring

11. All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Construction Noise

12. All construction noise monitoring was conducted as scheduled in the reporting month. One Action Level exceedance was recorded due to the complaint received on 25th February 2011.

Water Quality

13. Marine water quality monitoring was temporary suspended starting from 31st October 2009.

Construction Ground Borne Noise

14. All construction ground borne noise monitoring was conducted in the reporting month. No Action/Limit Level exceedance was recorded.

Intake DG1

Construction Noise

15. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake E5A

Construction Noise

16. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake E7

Construction Noise

17. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Monthly EM&A Report – February 2011

Intake MA14

Construction Noise

18. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake PFLR1

Construction Noise

19. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake RR1

Construction Noise

20. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake W0

Construction Noise

21. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake W5

Construction Noise

22. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake P5

Construction Noise

23. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake W8

Construction Noise

24. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake BR6

Construction Noise

25. All construction noise monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Intake GL1

Construction Noise

26. One Action Level exceedance was recorded due to the complaint received on 18th February 2011.

Environmental Licenses and Permits

- 27. Licenses/Permits granted to the Project include the Environmental Permit (EP) for the Project, An Environmental Permit No. EP-272/2007 was issued on 26 April 2007 and Environmental Permit No. EP-272/2007/A was issue on 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture.
- 28. Registration of Chemical Waste Producer (License: 5213-148-D2393-02 for Eastern Portal and No. 5213-172-D2393-01 for Western Portal).
- 29. Water Discharge License (License No.: EP860/W10/XY0175 for Area of Mount Butler Office, EP860/W10/XY0177 for Eastern Portal, EP820/W9/XT086 and WT00005864-2010 for Western Portal, EP860/W10/XY0183 for Intake W0, WT00003372-2009 for Intake SM1, WT00003737-2009 for Intake MB16, WT00004126-2009 for Intake HKU1, WT00003738-2009 for THR2, WT00004270-2009 for PFLR1, WT00004806-2009 for Intake E7, WT00004808-2009 for MBD2, WT00004885-2009 for Intake RR1, WT00005135-2009 for Intake W10, WT00005357-2009 for Intake W5, WT00005374-2009 for Intake P5, WT00005376-2009 for Intake TP4, WT00005588-2009 for Intake TP5, WT00005643-2009 for Intake E5A, WT00005754-2010 for Intake W8, WT00005954 for Intake TP789, WT00005915 for Intake E5B, WT00006102-2010 for Intake M3, WT00006415-2010 for Intake MA15, WT00006420-2010 for Intake MA17, WT00006428-2010 for Intake BR6, WT00006609-2010 for Intake HR1, WT00006559-2010 for Intake CR1, WT00006929-2010 for Intake W1, WT00006418-2010 for Intake MA14, WT00006865-2010 for Intake BR5, WT00007039-2010 for Intake DG1 WT00007042-2010 for Intake W3, WT00007043-2010 for Intake GL1, WT00007130-2010 for Intake BR4, WT00007139-2010 for Intake BR6 - SNH17 and WT00007319-2010 for Intake B2).
- 30. Construction Noise Permit (License No.: GW-RS0734-10 and GW-RS0125-11 for Eastern Portal, GW-RS1054-10 and GW-RS0066-11 for Western Portal, GW-RS0733-10 and GW-RS0149-11 for Intake W0, GW-RS0699-10 for Intake SM1, GW-RS0710-10 and GW-RS0167-11 for Intake PFLR1, GW-RS0995-10 for Intake W3, GW-RS1071-10 and GW-RS0147 for Intake MA17.

Key Information in the Reporting Month

31. Summary of key information in the reporting month is tabulated in Table II.

Table II Summary Table for Key Information in the Reporting Month

Event	I	Event Details	Action Taken	Status	Remark
	Number	Nature			
Complaint received	1	Construction noise at Intake GL1	Investigation Completed	Closed	
Complaint received	1	Construction noise at Western Portal	Under Investigation	In-progress	
Changes to the assumptions and key construction / operation activities recorded	0		N/A	N/A	
Status of submissions under EP	1	Monthly EM&A Report (January 2011)	Submitted to EPD on 21 January 2011 (EP condition 3.3)	Verified by IEC	
Notifications of any summons & prosecutions received	0		N/A	N/A	

Future Key Issues:

Major site activities for the coming month include:

- TBM excavation adit excavation at West Portal and Adit excavation & stage II river channel works at East Portals:
- Permanent Adit lining works at MB16 & W0;
- Stilling chamber lining works at MBD2, THR2, TP4 and TP5;
- Landscaping work at Intake SM1;
- Stage 1 Structure Construction at Intake MA15 and W10;
- Stage 2 works at MB16;
- Excavation of dropshaft at Intakes MA15, DG1 and TP789 by Raise Boring method;
- Dropshaft pilot hole at Intakes MA15, DG1, HKU1 and E5B by Raise Boring Method;
- Excavation of intake structure at Intakes E7, E5A, BR5, W1, MA17, BR4, BR6, W10, RR1, W5, M3, HR1, W3, MA14, PFLR1 and B2;
- Cofferdam construction at Intakes W8 and CR1;
- Casting dropshaft precast rings;
- Permanent dropshaft lining works at MBD2; and
- RCD pump tests for P5 and RR1.

Monthly EM&A Report – February 2011

1. INTRODUCTION

Background

- 1.1 Drainage Improvement in Northern Hong Kong Island Hong Kong West Drainage Tunnel is a Designated Project (hereafter referred to as "the Project") under the Environmental Impact Assessment Ordinance (Cap. 449). A study of environmental impact assessment (EIA) was undertaken to consider the key issues of air quality, noise, water quality, ecological, construction waste, landscape and visual, land use, cultural impacts, and identify possible mitigation measures associated with the works. An EIA Report was approved by the Environmental Protection Department (EPD) on 7 April 2006.
- 1.2 The project comprises the construction of a drainage tunnel deep into the ground in Midlevels of the Northern Hong Kong Island from Tai Hang to Pokfulam to intercept and convey the stormwater from the upper catchment directly to the sea near Cyberport. The Drainage tunnel alignment starts from the Eastern Portal near Haw Par Mansion in Tai Hang and ends at the Western Portal located to the north of Cyberport running underneath the Pok Fu Lam, Tai Tam, Aberdeen and Lung Fu Shan Country Parks. The underground main drainage tunnel is 6.25m-7.25m in diameter and about 11km long. Two portals and a series of connecting adits and drop shafts are also been constructed. The general layout of the Project is shown in **Figure 1.1**.
- 1.3 An Environmental Permit (EP) No. EP-272/2007 was issued on 26 April 2007 for Drainage Improvement in Northern Hong Kong Island Hong Kong West Drainage Tunnel to Drainage Services Department as the Permit Holder. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture.
- 1.4 Cinotech Consultants Limited was commissioned by the Dragages-Nishimatsu Joint Venture (the Contractor) to undertake the Environmental Monitoring and Audit (EM&A) works for the Project. The Updated EM&A Manual was prepared by Cinotech to fulfil the requirements of the EP. The construction commencement of this Contract at Eastern Portal was on 17th April 2008 and 2nd May 2008 at Western Portal (land-based). The marine construction works was commenced on 30 May 2008. This is the 35th monthly EM&A report summarizing the EM&A works for the Project in February 2011.

Project Organizations

- 1.5 Different parties with different levels of involvement in the project organization include:
 - Project Proponent Drainage Services Department (DSD).
 - The Supervising Officer or Supervising Officer's Representative (SO or SOR) Ove Arup & Partners (ARUP).
 - Environmental Team (ET) Cinotech Consultants Limited (CCL).
 - Independent Environmental Checker (IEC) Allied Environmental Consultants Limited (AEC).
 - Contractor Dragages-Nishimatsu Joint Venture (DNJV).

- 1.6 The responsibilities of respective parties are detailed in Sections 1.14 to 1.28 of the updated EM&A Manual of the Project.
- 1.7 The key contacts of the Project are shown in Table 1.1 and the organization chart of ET is shown in **Figure 2.1**.

Table 1.1 Key Project Contacts

Party	Role	Name	Position	Phone No.	Fax No.
DNJV	Permit Holder	Mr. ALTIER Daniel	Project Manager	2671 7333	2671 9300
21.0 (1 Grante Horaco	Mr. UETAKE H.	Deputy Project Manager	2071 7333	20,1,500
		Mr. Jackson Wong	SRE	6117 6636	
ARUP	Supervising Officer	Ms. Angela Yan	RE	3961 5206	2436 1012
		Mr. Bernard Cheng	RE	98614939	
	tech Environmental Team	Dr. Priscilla Choy	ET Leader	2151 2089	
Cinotech		Ms. Ivy Tam	Project Coordinator and Audit Team Leader	2151 2090	3107 1388
		Mr. Henry Leung	Monitoring Team Leader	2151 2087	
AEC Independent Environmental Checker Ms. Grace Kwok Environmental Checker		2815 7028	2815 5399		
DNJV	Contractor	Mr. Sing Chu	Environmental Officer	3476 0753	2671 9300

Construction Programme

- 1.8 The site activities undertaken in the reporting month included:
 - TBM excavation and adit excavation at Western Portal and Adit excavation Spoil Basin dismantle at Eastern Portal;
 - East TBM dismantling completed (except for main bearing transportation);
 - West TBM dismantling on-going;
 - RBM setup at intake DG1.
 - Dropshaft RBM. Reaming ongoing at Intake TP789 & GL1;
 - Dropshaft reaming completed at Intake TP5, TP4 on 11Feb11 and 01Feb11 respectively;
 - Cofferdam construction at Intakes W8, MA14, CR1;
 - Preparation works for RCD pump tests at intakes P5 and RR1;

- Excavation of intake structure at Intakes E7, W10, W3, BR6, HR1, PFLR1, BR5, W1, W5, E5A, BR4, B2 and M3;
- Permanent Intake structure works at SM1, HKU1, E5B, MBD2, MA15, and THR2;
- Dropshaft Lining Works at MB16;
- Slopeworks- soil nailing and installation of erosion control mat at Intake M3 complete;
- Resumption of works at Intake W0. Adit lining on-going;
- DDA submissions for Adit/Main Tunnel Intersection, Adits, Stilling Chambers and Turning Bays;
- DDA submissions for temporary works, slope works and permanent works for Intake Structures;
- DDA submissions for temporary and permanent works for Dropshafts;
- Environmental impact monitoring; and
- Casting of dropshaft precast rings.

Table 1.2 Construction Programme Showing the Inter-Relationship with Environmental Protection/Mitigation Measures

Protection/Mitigation Measures							
Construction Works	Major Environmental Impact	Control Measures					
TBM excavation and adit excavation at Western Portal and Adit excavation Spoil Basin dismantle at Eastern Portal East TBM and West TBM dismantling RBM setup at intake DG1 Dropshaft RBM. Reaming ongoing at Intake TP789 & GL1 Preparation works for RCD pump tests at intakes P5 and RR1 Cofferdam construction at Intakes W8, MA14, CR1 Excavation of intake structure at Intakes E7, W10, W3, BR6, HR1, PFLR1, BR5, W1, W5, E5A, BR4, B2 and M3 Permanent Intake structure works at SM1, HKU1, E5B, MBD2, MA15, and THR2 Dropshaft Lining Works at MB16 Slopeworks- soil nailing and installation of erosion control mat at Intake M3 Resumption of works at Intake W0. Adit lining ongoing	Noise, dust impact, water quality and waste generation	Provided water spraying during dust generation works On-site waste sorting and implementation of trip ticket system Appropriate desilting/sedimentation devices provided on site for treatment before discharge Use of quiet plant and well-maintained construction plant Provide movable noise barrier Provide sufficient mitigation measures as recommended in Approved EIA Report					
DDA submissions for Adit/Main Tunnel Intersection, Adits, Stilling Chambers and Turning Bays DDA submissions for temporary works, slope works and permanent works for Intake Structures DDA submissions for temporary and permanent works for Dropshafts Environmental impact monitoring Casting of dropshaft precast rings	Nil	Nil					

Summary of EM&A Requirements

- 1.9 The EM&A programme requires construction phase monitoring construction noise, air quality and water quality and environmental site audit. The EM&A requirements for each parameter are described in the following sections, including:
 - All monitoring parameters;
 - Action and Limit levels for all environmental parameters;
 - Event Action Plans;
 - Environmental mitigation measures, as recommended in the project EIA study final report; and
 - Environmental requirements in contract documents.
- 1.10 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 5 of this report.
- 1.11 This report presents the monitoring results, observations, locations, equipment, period, methodology and QA/QC procedures of the required monitoring parameters, namely air quality, water quality and noise levels and audit works for the Project in February 2011.

2. AIR QUALITY

Monitoring Requirements

2.1 1-hour and 24-hour TSP monitoring were conducted to monitor the air quality at Eastern and Western Portals. **Appendix A** shows the established Action/Limit Levels for the environmental monitoring works.

Monitoring Locations

2.2 Three designated monitoring stations, AQ1, AQ2 and AQ3 were selected for impact dust monitoring. Table 2.1 describes the air quality monitoring locations, which are also depicted in **Figure 3.1a-b.**

Table 2.1 Locations for Air Quality Monitoring

Monitoring Stations	Locations
AQ1	True Light Middle School of Hong Kong
AQ2	Outside Aegean Terrace
AQ3	Outside The Site Office at Western Portal

Monitoring Equipment

2.3 Table 2.2 summarizes the equipment used in the impact air monitoring programme. Copies of calibration certificates are attached in **Appendix B**.

Table 2.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Quantity
Calibrator	G25A	1
1-hour TSP Dust Meter	Laser Dust Monitor – Model LD3B	1
HVS Sampler	GMWS 2310 c/w of TSP sampling inlet	2

Monitoring Parameters, Frequency and Duration

2.4 Table 2.3 summarizes the monitoring parameters and frequencies of impact dust monitoring for the whole construction period. The air quality monitoring schedule for the reporting month is shown in **Appendix D**.

 Table 2.3
 Impact Dust Monitoring Parameters, Frequency and Duration

Parameters	Frequency
1-hr TSP	Three times / 6 days
24-hr TSP	Once / 6 days

Monitoring Methodology and QA/QC Procedure

1-hour TSP Monitoring

Measuring Procedures

- 2.5 The measuring procedures of the 1-hour dust meters were in accordance with the Manufacturer's Instruction Manual as follows:
 - Pull up the air sampling inlet cover
 - Change the Mode 0 to BG with once
 - Push Start/Stop switch once
 - Turn the knob to SENSI.ADJ and press it
 - Push Start/Stop switch once
 - Return the knob to the position MEASURE slowly
 - Push the timer set switch to set measuring time
 - Remove the cap and make a measurement

Maintenance/Calibration

- 2.6 The following maintenance/calibration was required for the direct dust meters:
 - Check the meter regularly and calibrate the meter at bi-monthly interval throughout all stages of the air quality monitoring.

24-hour TSP Monitoring

Instrumentation

2.7 High volume (HVS) samplers (Model GMWS-2310 Accu-Vol) completed with appropriate sampling inlets were employed for 24-hour TSP monitoring. The sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complied with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50). Moreover, the HVS also met all the requirements in section 2.5 of the updated EM&A Manual.

Operating/Analytical Procedures

- 2.8 Operating/analytical procedures for the operation of HVS were as follows:
 - A horizontal platform was provided with appropriate support to secure the samplers against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.

- The sampler was more than 20 meters from the drip line.
- Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.
- 2.9 Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 1.1 m³/min. and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50.
- 2.10 Fiberglass filters were used which have a collection efficiency of larger than 99% for particles of 0.3 µm diameter.
- 2.11 The power supply was checked to ensure the sampler worked properly. On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the designated air monitoring station.
- 2.12 The filter holding frame was then removed by loosening the four nuts and a weighted and conditioned filter was carefully centered with the stamped number upwards, on a supporting screen.
- 2.13 The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- 2.14 The shelter lid was closed and secured with the aluminum strip.
- 2.15 The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- 2.16 After sampling, the filter was removed and sent to the HOKLAS laboratory (Wellab Ltd.) for weighing. The elapsed time was also recorded.
- 2.17 Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment temperature should be between 25°C and 30°C and not vary by more than ±3°C; the relative humidity (RH) should be < 50% and not vary by more than ±5%. A convenient working RH is 40%.

Maintenance/Calibration

- 2.18 The following maintenance/calibration was required for the HVS:
 - The high volume motors and their accessories were properly maintained. Appropriate
 maintenance such as routine motor brushes replacement and electrical wiring checking
 were made to ensure that the equipment and necessary power supply are in good working
 condition.
 - High volume samplers were calibrated at bi-monthly intervals using G-25A Calibration Kit throughout all stages of the air quality monitoring.

Results and Observations

Eastern Portal (AQ1)

- 2.19 All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.
- 2.20 All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Western Portal (AQ2)

2.21 All 1-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Western Portal (AQ3)

- 2.22 All 24-hour TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.
- 2.23 Wind data was obtained from the Meteorological Observations for King's Park Automatic Weather Station for Eastern Portal and Wong Chuk Hang Automatic Weather Station for Western Portal. These wind data for the reporting period is summarized in **Appendix C.**
- 2.24 The monitoring data and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices E and F** respectively.
- 2.25 The summary of exceedance record in reporting month is shown in **Appendix H**.
- 2.26 In accordance with Condition 4.2 of the EP, all environmental monitoring data was made available to the public via internet access at the website http://www.cinotech.com.hk/projects/WestDrainageTunnel/.
- 2.27 According to our field observations, the major dust source identified at the designated air quality monitoring stations are as follows:

	Station	Major Noise Source
Area		
Eastern Portal	AQ1 – True Light Middle School of Hong Kong	Road Traffic Dust Loading/unloading activities
Western Portal	AQ2 – Outside Aegean Terrace AQ3 – Outside The	Road Traffic Dust Loading/unloading activities
	Site Office at Western Portal	

Table 2.4 Summary Table of Air Quality Monitoring Results during the reporting month

Parameter	Date	Concentration (µg/m3)	Action Level, µg/m3	Limit Level, µg/m3		
Eastern Porta	Eastern Portal					
	7-Feb-11	100.0				
	7-Feb-11	47.9				
	7-Feb-11	29.6				
	11-Feb-11	96.7				
	11-Feb-11	89.7				
1-hr TSP	11-Feb-11	91.2	245	500		
(AQ1)	17-Feb-11	202.9	345	500		
	17-Feb-11	204.4				
	17-Feb-11	240.9				
	23-Feb-11	89.6				
	23-Feb-11	32.2				
	23-Feb-11	57.4				
	1-Feb-11	135.7				
04.1 TCD	7-Feb-11	101.4				
24-hr TSP	11-Feb-11	75.1	201	260		
(AQ1)	17-Feb-11	62.1				
	23-Feb-11	60.0				
Western Port	al					
	7-Feb-11	181.7				
	7-Feb-11	182.0				
	7-Feb-11	181.2				
	11-Feb-11	206.5				
	11-Feb-11	205.9				
1-hr TSP	11-Feb-11	206.1	221	500		
(AQ2)	17-Feb-11	239.3	321	500		
	17-Feb-11	238.7				
l l	17-Feb-11	239.8				
l l	23-Feb-11	98.1				
l l	23-Feb-11	98.2				
	23-Feb-11	97.7				
	1-Feb-11	105.1				
24 by TCD	7-Feb-11	99.1				
24-hr TSP	11-Feb-11	106.0	156	260		
(AQ3)	17-Feb-11	132.1				
	23-Feb-11	88.6				

3. NOISE

Airborne Construction Noise Monitoring

Monitoring Requirements

3.1 Eighteen noise monitoring stations, namely NC1, NC2, NC3, NC4, NC5, NC6, NC7, NC8, NC9, NC10, NC11, NC12, NC13, NC14, NC15, NC16, NC17, NC18 and NC19 were selected for impact monitoring in the reporting month. **Appendix A** shows the established Action and Limit Levels for the environmental monitoring works.

Monitoring Locations

3.2 Noise monitoring was conducted at ten designated monitoring stations as listed in Table 3.1. **Figure 3.1a-n** shows the locations of these stations.

Table 3.1 Noise Monitoring Stations

Monitoring Stations	Locations	
NC1/NC1a	True Light Middle School of Hong Kong/Outside True Light	
NCI/NCIa	Middle School of Hong Kong	
NC2	The Legend	
NC3	Outside Aegean Terrace	
NC4	Man Yuen Garden	
NC5	Blk D Villa Monte Rosa	
NC6	Rosaryhill School	
NC7	Buddist Li Ka Shing Care & Attention Home for the Elderly	
NC8	Marymount Secondary School	
NC9	117 Blue Pool Road	
NC10	The Harbour View	
NC11	Honey Court	
NC12	Ying Wa Girl's School	
NC13	Peaksville Court	
NC14	Hong Kong Japanese School	
NC15	Hong Kong Academy	
NC16	Raimondi College	
NC17	Hong Kong Institute of Technology	
NC18	Blk A, 80 Robinson Road	
NC19	Villa Veneto	

Monitoring Equipment

3.3 Table 3.2 summarizes the noise monitoring equipment. Copies of calibration certificates are provided in **Appendix B**.

Table 3.2 Noise Monitoring Equipment

Equipment	Model and Make	Qty.
Integrating Sound Level Meter	SVAN 955, 957	4
Calibrator	B&K 4231 and SVAN 30A	4

Monitoring Parameters, Frequency and Duration

3.4 Table 3.3 summarizes the monitoring parameters, frequency and total duration of monitoring. The noise monitoring schedule is shown in **Appendix D**.

 Table 3.3
 Noise Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Period	Frequency	Measurement
NC1 NC2 NC3 NC4 *NC5 NC6 NC7 NC8 NC9 NC10 *NC11 NC12 NC13 NC14 *NC15 NC16 NC17 NC18	$\begin{array}{c} L_{10}(30 \text{ min.}) \\ dB(A) \\ L_{90}(30 \text{ min.}) \\ dB(A) \\ L_{eq}(30 \text{ min.}) \\ dB(A) \end{array}$	0700-1900 hrs on normal weekdays	Once per week	Façade
NC1a NC2 NC3	$\begin{array}{c} L_{10}(5 \text{ min.}) \\ dB(A) \\ L_{90}(5 \text{ min.}) \\ dB(A) \\ L_{eq}(5 \text{ min.}) \\ dB(A) \end{array}$	1900 – 2300 hrs on all other days 0700 – 2300 hrs holidays & 2300 – 0700 hrs of next day		

^{*}Free Field Measurement

Monitoring Methodology and QA/QC Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2 m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces. All records for free field noise levels were adjusted with a correction of +3 dB(A).

- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:

frequency weighting : Atime weighting : Fast

time measurement : 30 minutes / 5 minutes

- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1.0 dB, the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with the portable wind meter.
- At the end of the monitoring period, the L_{eq} , L_{90} and L_{10} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused temporarily during periods of high intrusive noise if possible and observation was recorded when intrusive noise was not avoided.
- Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.

Maintenance and Calibration

- 3.5 The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- 3.6 The sound level meter and calibrator were checked and calibrated at yearly intervals.
- 3.7 Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration levels from before and after the noise measurement agree to within 1.0 dB.

Results and Observations

- Noise monitoring (0700-1900 hrs on normal weekdays, 1900-2300 hrs on all other days, 2300-0700 hrs of next day and 0700-1900 hrs on holidays) at the three designated locations (NC1/NC1a (for restricted hours), NC2 and NC3) was conducted as scheduled in the reporting month for Eastern and Western Portal.
- 3.9 As the noise monitoring for restricted hours inside the True Light Middle School of Hong Kong (NC1) throughout the construction period will cause disturbance to them. Thus, the noise monitoring for evening time will be conducted at outside the school (NC1a) at the nearest of the staff accommodation. As no baseline noise monitoring has been conducted at NC1a and the major noise source was the traffic noise along Tai Hang Road. The noise monitoring results will be adjusted with the reference baseline noise level at NC1 (1900-2300 on all other days and 0700 2300 hrs holidays & 2300 0700 hrs of next day) and will be used as reference only.
- 3.10 Noise monitoring (0700-1900 hrs on normal weekdays) at NC4, NC5, NC6, NC7, NC8, NC9, NC10, NC11, NC12, NC13, NC14, NC15, NC16, NC17, NC18 and NC19 were conducted as scheduled in the reporting month for Intake BR6, Intake DG1, E5A, E7, MA14,

PFLR1, RR1, THR2, W0, W5 and P5 respectively.

Eastern Portal (NC1 & NC2) – 0700-1900 hrs on normal weekdays

3.11 No Action/Limit Level exceedance was recorded.

Eastern Portal (NC1a & NC2) – 1900-2300 hrs on all other days and 0700-2300 hrs on holidays

3.12 No Action/Limit Level exceedance was recorded.

Eastern Portal (NC1a & NC2) – 2300-0700 hrs of next day

3.13 No Action/Limit Level exceedance was recorded.

Western Portal (NC3) – 0700-1900 hrs on normal weekdays

3.14 One Action Level exceedance was recorded due to the complaint received on 25th February 2011.

Western Portal (NC3) – 1900-2300 hrs on all other days and 0700-2300 hrs on holidays

3.15 No Action/Limit Level exceedance was recorded.

Western Portal (NC3) – 2300-0700 hrs of next day

One Action Level exceedance was recorded due to the complaint received on 25th February 2011.

Intake BR6 (NC4) – 0700-1900 hrs on normal weekdays

3.16 No Action/Limit Level exceedance was recorded.

Intake DG1 (NC5) – 0700-1900 hrs on normal weekdays

3.17 No Action/Limit Level exceedance was recorded.

Intake DG1 (NC6) – 0700-1900 hrs on normal weekdays

3.18 No Action/Limit Level exceedance was recorded.

Intake E5A (NC7) – 0700-1900 hrs on normal weekdays

3.19 No Action/Limit Level exceedance was recorded.

Intake E7 (NC8) – 0700-1900 hrs on normal weekdays

3.20 No Action/Limit Level exceedance was recorded.

Intake E7 (NC9)	<u>) – 0700-1900 hrs on normal weekda</u>	ys

- 3.21 No Action/Limit Level exceedance was recorded.
 - Intake MA14 (NC10) 0700-1900 hrs on normal weekdays
- 3.22 No Action/Limit Level exceedance was recorded.
 - Intake PFLR1 (NC11) 0700-1900 hrs on normal weekdays
- 3.23 No Action/Limit Level exceedance was recorded.
 - Intake RR1 (NC12) 0700-1900 hrs on normal weekdays
- 3.24 No Action/Limit Level exceedance was recorded.
 - Intake RR1 (NC13) 0700-1900 hrs on normal weekdays
- 3.25 No Action/Limit Level exceedance was recorded.
 - Intake THR2 (NC14) 0700-1900 hrs on normal weekdays
- 3.26 No Action/Limit Level exceedance was recorded.
 - Intake W0 (NC15) 0700-1900 hrs on normal weekdays
- 3.27 No Action/Limit Level exceedance was recorded.
 - Intake W5 (NC16) 0700-1900 hrs on normal weekdays
- 3.28 No Action/Limit Level exceedance was recorded.
 - Intake W8 (NC17) 0700-1900 hrs on normal weekdays
- 3.29 No Action/Limit Level exceedance was recorded.
 - Intake W8 (NC18) 0700-1900 hrs on normal weekdays
- 3.30 No Action/Limit Level exceedance was recorded.
 - Intake P5 (NC19) 0700-1900 hrs on normal weekdays
- 3.31 No Action/Limit Level exceedance was recorded.

Intake GL1 – 0700-1900 hrs on normal weekdays

- 3.32 One Action levels exceedance was recorded due to the complaint received on 18th February 2011.
- 3.33 The summary of exceedance record in reporting month is shown in **Appendix H**.
- 3.34 All the Construction Noise Levels (CNLs) reported in this report were adjusted with the corresponding baseline level (i.e. Measured Leq Baseline Leq = Measured CNL), in order to facilitate the interpretation of the noise exceedance. The baseline noise level and the Noise Limit Level at each designated noise monitoring station are presented at Table 3.4.
- 3.35 Noise monitoring results and graphical presentations are shown in **Appendix G**. In accordance with Condition 4.2 of the EP, all environmental monitoring data was made available to the public via internet access at the website http://www.cinotech.com.hk/projects/WestDrainageTunnel/.

3.36 The major noise sources identified at the designated noise monitoring stations are as follows:

Area	Station	Major Noise Source
Eastern Portal	NC1 – True Light Middle School of Hong Kong	Traffic Noise Loading/unloading activities
	NC2 – The Legend	
Western Portal	NC3 – Outside Aegean Terrace	Traffic Noise Loading/unloading activities
Intake BR6	NC4 - Man Yuen Garden	Traffic Noise Excavation works
Intake DG1	NC5 - Blk D Villa Monte Rosa NC6 - Rosaryhill School	Traffic Noise Excavation works
Intake E5A	NC7 - Buddist Li Ka Shing Care & Attention Home for the Elderly	Traffic Noise Excavation works
Intake E7	NC8 – Marymount Secondary School NC9 – 117 Blue Pool Road	Traffic Noise Excavation works
Intake MA14	NC10 - The Harbour View	Traffic Noise Excavation works
Intake PFLR1	NC11 – Honey Court	Traffic Noise Excavation works
Intake RR1	NC12 – Ying Wa Girl's School NC13 – Peaksville Court	Traffic Noise Excavation works
Intake THR2	NC14 – Hong Kong Japanese School	Traffic Noise Excavation works
Intake W0	NC15 – Hong Kong Academy	Traffic Noise
Intake W5	NC16 - Raimondi College	Traffic Noise Excavation works
Intake W8	NC17 - Hong Kong Institute of Technology NC18 - Blk A, 80 Robinson Road	Traffic Noise Excavation works
Intake P5	NC19 – Villa Veneto	Traffic Noise Excavation works

Table 3.4 Baseline Noise Level and Noise Limit Level for Monitoring Stations

Station	Baseline Noise Level, dB (A) Noise Limit Level,		
Station	Dascinic Noise Level, ub (A)	dB (A)	
NC1 To I lake Middle	70.2 (-+ 0700 1000 1	` '	
NC1 – True Light Middle	70.2 (at 0700 – 1900 hrs on normal	70* (at 0700 – 1900 hrs	
School of Hong Kong	weekdays)	on normal weekdays)	
NC1a – Outside True Light	65.8 (at 0700 – 2300 hrs holidays &	65 (at 0700 – 2300 hrs	
Middle School of Hong	1900 – 2300 hrs on all other days)	holidays & 1900 –	
Kong (the nearest of staff	60.7 (at 2300 – 0700 hrs of next	2300 hrs on all other	
accommodation)	day)	days)	
	(reference)		
		50 (at 2300 – 0700 hrs	
		of next day)	
NC2 – The Legend	64.8 (at 0700 – 1900 hrs on normal	• /	
	weekdays)		
	59.1 (at 0700 – 2300 hrs holidays &	75 (at 0700 – 1900 hrs	
	1900 – 2300 hrs on all other days)	on normal weekdays)	
	53.9 (at 2300 – 0700 hrs of next day)		
NC3 – Outside Aegean	57.7 (at 0700 – 1900 hrs on normal	65 (at 0700 – 2300 hrs	
Terrace	weekdays)	holidays & 1900 –	
	53.8 (at 0700 – 2300 hrs holidays &	2300 hrs on all other	
	1900 – 2300 hrs on all other days)	days)	
	52.0 (at 2300 – 0700 hrs of next day)	days	
	32.0 (at 2300 – 0700 his of hext day)	50 (at 2300 – 0700 hrs	
		of next day)	
NC4 – Man Yuen Garden	64.5 (at 0700 – 1900 hrs on normal	75 (at 0700 – 1900 hrs	
NC4 – Ivian Tuen Garden	weekdays)	on normal weekdays)	
	61.6 (at 0700 – 2300 hrs holidays &	on normal weekdays)	
	1900 – 2300 hrs on all other days)		
	•		
NC5 Dile D Villa Manta	54.8 (at 2300 – 0700 hrs of next day)	75 (at 0700 1000 has	
NC5 - Blk D Villa Monte	66.1(at 0700 – 1900 hrs on normal	75 (at 0700 – 1900 hrs	
Rosa	weekdays)	on normal weekdays)	
NCC December Cohect	64.1 (at 0700 1000 has an assertable	70* (at 0700 – 1900 hrs	
NC6 - Rosaryhill School	64.1 (at 0700 – 1900 hrs on normal	`	
	weekdays)	on normal weekdays)	
NC7 - Buddist Li Ka	65.1 (at 0700 – 1900 hrs on normal	75 (at 0700 – 1900 hrs	
Shing Care & Attention	weekdays)	on normal weekdays)	
Home for the Elderly			
NC8 – Marymount	63.5 (at 0700 – 1900 hrs on normal	70* (at 0700 – 1900 hrs	
Secondary School	weekdays)	on normal weekdays)	
NC9 – 117 Blue Pool Road	63.3 (at 0700 – 1900 hrs on normal	75 (at 0700 – 1900 hrs	
117 Blue I ool Road	weekdays)	on normal weekdays)	
	• *	<u> </u>	
NC10 – The Harbour View	71.7 (at 0700 – 1900 hrs on normal	75 (at 0700 – 1900 hrs	
	weekdays)	on normal weekdays)	
NC11 – Honey Court	63.2 (at 0700 – 1900 hrs on normal	75 (at 0700 – 1900 hrs	
]	weekdays)	on normal weekdays)	
	······································		

NC12 – Ying Wa Girl's School	67.1 (at 0700 – 1900 hrs on normal weekdays)	70* (at 0700 – 1900 hrs on normal weekdays)
NC13 - Peaksville Court	65.2 (at 0700 – 1900 hrs on normal weekdays)	75 (at 0700 – 1900 hrs on normal weekdays)
NC14 – Hong Kong Japanese School	60.8 (at 0700 – 1900 hrs on normal weekdays)	70* (at 0700 – 1900 hrs on normal weekdays)
NC15 – Hong Kong Academy	63.5 (at 0700 – 1900 hrs on normal weekdays)	70* (at 0700 – 1900 hrs on normal weekdays)
NC16 - Raimondi College	70.4 (at 0700 – 1900 hrs on normal weekdays)	70* (at 0700 – 1900 hrs on normal weekdays)
NC17 - Hong Kong Institute of Technology	66.0 (at 0700 – 1900 hrs on normal weekdays)	70* (at 0700 – 1900 hrs on normal weekdays)
NC18 - Blk A, 80 Robinson Road	64.8 (at 0700 – 1900 hrs on normal weekdays)	75 (at 0700 – 1900 hrs on normal weekdays)
NC19 – Villa Veneto	68.6 (at 0700 – 1900 hrs on normal weekdays)	75 (at 0700 – 1900 hrs on normal weekdays)

^(*) reduce to 65 dB(A) during school examination periods.

 Table 3.5
 Summary Table of Noise Monitoring Results during the Reporting Month

Parameter	Date	Construction Noise Level : Leq(30min) dB (A)	Action Level	Limit Level,
07:00 - 19:0	0 hrs on normal	weekdays		J
Eastern Porta	1			
	2-Feb-11	68.2 Measured ≤ Baseline		
NC1	8-Feb-11	60.9 Measured ≤ Baseline		70*dB(A)
NCI	14-Feb-11	64.8	When one	70 'db(A)
	22-Feb-11	68.1	documented	
	2-Feb-11	55.7	complaint is	
NC2	8-Feb-11	$61.8 \text{ Measured} \leq \text{Baseline}$	received	75 dD(A)
NC2	14-Feb-11	56.5		75dB(A)
	22-Feb-11	71.6		
Western Port	al			
	2-Feb-11	53.7 Measured ≤ Baseline	When one	
NC3	8-Feb-11	52.3 Measured ≤ Baseline	documented	75dB(A)
NC3	14-Feb-11	53.0 Measured ≤ Baseline	complaint is	/3ub(A)
	22-Feb-11	53.7 Measured ≤ Baseline	received	
Intake BR6	-		-	
	2-Feb-11	69.8	When one	75 dD(A)
NC4	8-Feb-11	62.7	documented	
NC4	14-Feb-11	67.1	complaint is	75dB(A)
	22-Feb-11	66.9	received	
Intake DG1				
	2-Feb-11	63.3 Measured ≤ Baseline		75dB(A)
NC5	8-Feb-11	$65.3 \text{ Measured} \leq \text{Baseline}$		
NCS	14-Feb-11	63.5	When one	/3db(A)
	22-Feb-11	59.7	documented	
	2-Feb-11	62.3 Measured ≤ Baseline	complaint is	
NC6	8-Feb-11	$63.0 \text{ Measured} \leq \text{Baseline}$	received	70*dB(A)
NCO	14-Feb-11	55.8		70 'db(A)
	22-Feb-11	59.1		
Intake E5A				
	2-Feb-11	64.4 Measured ≤ Baseline	When one	
NC7	8-Feb-11	62.5	documented	75 dD(A)
NC/	14-Feb-11	74.3	complaint is	75dB(A)
	22-Feb-11	63.9 Measured ≤ Baseline	received	
Intake E7	-		-	•
	8-Feb-11	63.9		
NC8	14-Feb-11	61.2	When one	70*dB(A)
	22-Feb-11	64.4	documented	
	8-Feb-11	63.1	complaint is	
NC9	14-Feb-11	73.7	received	75dB(A)
	22-Feb-11	67.5		
Intake MA14				
NC10	2-Feb-11	71.4 Measured \leq Baseline	When one	75dB(A)
	8-Feb-11	$71.0 \text{ Measured} \leq \text{Baseline}$	documented	

_				
	14-Feb-11	71.3 Measured ≤ Baseline	complaint is	
	22-Feb-11	70.9 Measured ≤ Baseline	received	
Intake PFLR	.1			
	2-Feb-11	59.7	When one	
NC11	8-Feb-11	62.8	documented	75dB(A)
11011	14-Feb-11	60.6	complaint is	73412(71)
	22-Feb-11	62.8	received	
Intake RR1	1			T
	2-Feb-11	$65.2 \text{ Measured} \leq \text{Baseline}$		
NC12	8-Feb-11	64.7 Measured ≤ Baseline		70*dB(A)
	14-Feb-11	64.8 Measured ≤ Baseline	When one	(-)
	22-Feb-11	$65.7 \text{ Measured} \leq \text{Baseline}$	documented	
	2-Feb-11	65.4	complaint is received	
NC13	8-Feb-11	65.9	- ICCCIVEU	75dB(A)
	14-Feb-11	68.4	4	
L.4.1. TIDO	22-Feb-11	66.7		
Intake THR2		50.7	XX71	1
	2-Feb-11	59.7 57.0	When one documented	
NC14	8-Feb-11 14-Feb-11	63.2	complaint is	70*dB(A)
	22-Feb-11	63.6	received	
Intake W0	22 1 00 11	03.0		<u> </u>
Intake W	2-Feb-11	61.7	When one	
NG15	8-Feb-11	62.9	documented	70*dB(A)
NC15	14-Feb-11	62.4	complaint is	
	22-Feb-11	62.2	received	
Intake W5				
	2-Feb-11	63.0 Measured ≤ Baseline	When one	
Mate	8-Feb-11	63.7 Measured ≤ Baseline	documented	70 th 1D (4)
NC16	14-Feb-11	64.0 Measured ≤ Baseline	complaint is	70*dB(A)
	22-Feb-11	65.3 Measured ≤ Baseline	received	
Intake W8	11_		_1	<u> </u>
	2-Feb-11	60.1		
	8-Feb-11	61.0	_	
NC 17	14-Feb-11	62.5	When one	70*dB(A)
	22-Feb-11	64.4	documented	
	2-Feb-11	68.7	complaint is	
NC 10	8-Feb-11	67.9	received	75 ID (A)
NC 18	14-Feb-11	71.1	1	75dB(A)
	22-Feb-11	70.3		
Intake P5				
	2-Feb-11	64.7 Measured ≤ Baseline	When one	
<u> </u>	8-Feb-11	$63.2 \text{ Measured} \leq \text{Baseline}$	documented	75dB(A)
	14-Feb-11	66.7Measured ≤ Baseline	complaint is	
	22-Feb-11	64.5 Measured ≤ Baseline	received	

Parameter	Date	Construction Noise Level : Leq(5min) dB (A)	Action Level	Limit Level,
Eastern Porta	1		1	•
	2-Feb-11	52.5		
	6-Feb-11	64.4 Measured ≤ Baseline		
	8-Feb-11	52.5		
NC1a (Reference)	13-Feb-11	$65.0 \text{ Measured} \leq \text{Baseline}$		
	14-Feb-11	61.6		
	20-Feb-11	$65.1 \text{ Measured} \leq \text{Baseline}$	When one	
	22-Feb-11	$64.9 \text{ Measured} \leq \text{Baseline}$	When one documented	
	27-Feb-11	64.9	complaint is	65dB(A)
	2-Feb-11	63.0	received	0000(11)
	6-Feb-11	61.2		
	8-Feb-11	61.7		
NC2	13-Feb-11	58.7 Measured ≤ Baseline	_	
	14-Feb-11	62.7		
	20-Feb-11	58.7 Measured ≤ Baseline	 -	
	22-Feb-11	63.0		
	27-Feb-11	58.8 Measured ≤ Baseline		
Western Port			<u> </u>	T
	2-Feb-11	49.5 Measured ≤ Baseline	_	
	6-Feb-11	$51.3 \text{ Measured} \leq \text{Baseline}$		
	8-Feb-11	$49.8 \text{ Measured} \leq \text{Baseline}$	When one	
NC3	13-Feb-11	$52.2 \text{ Measured} \leq \text{Baseline}$	documented	65dB(A)
1,00	14-Feb-11	$49.7 \text{ Measured} \leq \text{Baseline}$	complaint is	0002(11)
	20-Feb-11	$53.7 \text{ Measured} \leq \text{Baseline}$	received	
	22-Feb-11	$50.3 \text{ Measured} \leq \text{Baseline}$		
	27-Feb-11	$53.1 \text{ Measured} \leq \text{Baseline}$		
(Restricted H	Hours – 23:00 –	07:00 hrs of next day)		
Eastern Porta	1			
	2-Feb-11	59.9 Measured ≤ Baseline		
NC1a	8-Feb-11	59.3 Measured ≤ Baseline		
(Reference)	14-Feb-11	60.7 Measured ≤ Baseline	When one	
	22-Feb-11	60.7 Measured ≤ Baseline	documented	50 ID(A)
	2-Feb-11	52.7 Measured ≤ Baseline	complaint is	50dB(A)
	8-Feb-11	52.2 Measured ≤ Baseline	received	
NC2	14-Feb-11	53.1 Measured ≤ Baseline	1	
	22-Feb-11	53.7 Measured ≤ Baseline		
Western Porta		 	I	I
NC3	3-Feb-11	51.9 Measured ≤ Baseline	When one	
	9-Feb-11	50.2 Measured ≤ Baseline	documented	
	15-Feb-11	50.9 Measured ≤ Baseline	complaint is	50dB(A)
	23-Feb-11	51.2 Measured ≤ Baseline	received	

^(*) reduce to 65 dB(A) during school examination periods.

Ground Borne Construction Noise Monitoring

Monitoring Requirements

3.37 In accordance with the recommendations of the EIA study, ground borne noise monitoring is required to carry out during the TBM operation. Eight designated monitoring stations (GNC1 to GNC8) are designated for construction groundborne noise monitoring to check for compliance.

Monitoring Locations

- 3.38 Construction Ground Borne Noise Monitoring at GNC3 was temporary suspended since 7 May 2009 as the ISS EastPoint Property Management Ltd. received an instruction from the Incorporated Owners of Aegean Terrace that we are not permitted to conduct any noise monitoring inside Aegean Terrace for the Project.
- 3.39 According to the approved EIA report, noise monitoring should be performed at NSR1a (i.e. Crane Court) when TBM is operating through the tunnel section between points A and B). Therefore, Ground borne noise monitoring has been conducted at Crane Court (GNC4) since 3 June 2009 during the TBM operated.
- 3.40 Ground borne noise monitoring at GNC1 True Light Middle School, GNC2 The Legend and GNC4 Crane Court were completed by end of August 2009 accordingly.
- 3.41 Ground borne noise monitoring at GNC5 was completed by end of November 2009.
- 3.42 Ground borne noise monitoring was conducted at GNC6 French International School in the reporting month during the TBM operation and completed by end of June 2010.
- 3.43 Ground borne noise monitoring was conducted at GNC7 Hong Villa in the reporting month. **Figure 3.10** shows the locations of the monitoring stations.

Monitoring Equipment

3.44 The noise monitoring equipment shall be the same as stated in Section 3.3.

Monitoring Parameters, Frequency and Duration

3.45 Table 3.6 summarizes the monitoring parameters, frequency and total duration of monitoring. The noise monitoring schedule is shown in **Appendix D**.

Table 3.6 Ground Borne Noise Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Period	Frequency
GNC7	L ₁₀ (30 min.) dB(A) L ₉₀ (30 min.) dB(A) L _{eq} (30 min.) dB(A)	0700-1900 hrs on normal weekdays	Once per week

Results and Observations

3.46 Groundborne Noise monitoring (0700-1900 hrs on normal weekdays) at Hong Villa (GNC7) was conducted as scheduled in the reporting month. The construction ground borne noise standards are presented at Table 3.7.

Hong Villa (GNC7) - 0700-1900 hrs on normal weekdays

3.47 No exceedance was recorded.

Table 3.7 Construction Ground Borne Noise Standards

	Ground Borne Noise Criteria, dB(A) (Leq 30 min)		
Uses	Daytime (except General Holidays and Sundays)*	Daytime during general holidays and Sundays and all days during Evening (1900 to 2300 hrs)**	Night time (2300 to 0700 hrs)
Domestic Premises	65	55	40
Educational Institutions (normal periods)	60	55	(1)
Education Institutions (during examination periods)	55	55	(1)

^{*10}dB(A) below the noise criteria stipulated in EIAO-TM

Table 3.8 Summary Table of Ground Borne Noise Monitoring Results during the Reporting Month

Parameter	Date	Construction Ground Borne Noise Level : Leq(30min) dB (A)	Standards	
GNC7	2-Feb-11	56.1		
	8-Feb-11	56.2	65 dB(A)	
	14-Feb-11	56.6		
	22-Feb-11	56.6		

^{**10}dB(A) below the noise criteria stipulated in GW-TM

⁽¹⁾ No sensitive uses usually present during these periods

Monthly EM&A Report – February 2011

4. WATER QUALITY

Monitoring Requirements

- 4.1 Dissolved oxygen (DO concentration in mg/L and DO saturation in percentage), Turbidity (Tby in NTU), Suspended Solid (SS in mg/L), pH, salinity and both water and ambient temperature monitoring were conducted to monitor the water quality. **Appendix A** shows the established Action/Limit Levels for the environmental monitoring works.
- 4.2 Proposal for Temporary Suspension of Water Quality Monitoring Western Portal was submitted on 15th September 2009 and approved by EPD on 30th October 2009. Marine water quality monitoring was temporary suspended starting from 31st October 2009 until there is marine-based construction activities resumed at the Western Portal (i.e. March of 2011 tentatively.)

Monitoring Locations

4.3 Locations of designated Water Quality Monitoring Stations are shown in **Figure 4.1a-b** and described in Table 4.1. Samples shall be taken at all designated Monitoring and Control Stations.

Table 4.1 Locations for Water Quality Monitoring

Manitaring Stations	Coord	inates
Monitoring Stations	Northing	Easting
Control Stations		
CE (Ebb)	814956	830026
CF (Flood)	812420	831778
Impact Stations		
I1	813654	831088
12	813582	831105
Intake A	813044	831603
Intake B	814583	830606

Results and Observations

4.4 No marine water quality monitoring was conducted during the reporting month.

Underground water level

- 4.5 Ground water levels were measured once per month during the construction phase in order to ensure the water levels at those intakes near to the natural stream courses and thus on the surrounding habitats will not be significantly affected.
- 4.6 Locations of designated ground water level (borehole with piezometer) monitoring station UC1 at Eastern Portal has been changed to ADH48 which was verified by IEC on 5th June 2008. The updated ground water level monitoring stations, TP789_DH2, TP5_DH2, THR2_DH7 and PFLR1_DH2 were also verified by IEC on 19th June 2010.

4.7 Ground water level monitoring location is shown in **Figure 4.2a-e** and the Monitoring data are shown in Table 4.2.

Table 4.2 Ground Water Level Monitoring Data

Date	Water Level (from ground)/m				
Location: ADH48 (Eastern Portal)					
11 February 2011	9				
Location: TP789_DH2					
14 February 2011	14.78				
Location: TP5_DH2					
14 February 2011	Obstructed				
Location: THR2_DH7					
15 February 2011	3.00				
Location:PFLR1_DH2					
4 February 2011	11.58				

5. ENVIRONMENTAL AUDIT

Site Audits

- 5.1 Site audits were carried out on a weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Project site. The summaries of site audits are attached in **Appendix I.**
- 5.2 Site audits were conducted on 10th, 18th and 24th February 2011. IEC site inspections were conducted on 24th February 2011. No non-compliance was observed during the site audits.
- 5.3 In order to assess the effectiveness of the implementation of water quality mitigation measures at Western Portal, additional site inspection was conducted on 2nd, 8th, 15th and 23rd February 2011. No non-compliance was observed during the site audits.

Review of Environmental Monitoring Procedures

5.4 The monitoring works conducted by the monitoring team were inspected regularly. The following observations have been recorded for the monitoring works:

Air Quality Monitoring

- The monitoring team recorded all observations around the monitoring stations within and outside the construction site.
- The monitoring team recorded the temperature and weather conditions on the monitoring days.

Noise Monitoring

- The monitoring team recorded all observations around the monitoring stations, which might affect the monitoring result.
- Major noise sources were identified and recorded. Other intrusive noise attributing to the result was trimmed off by pausing the monitoring temporarily.

Status of Environmental Licensing and Permitting

5.5 All permits/licenses obtained for the Project are summarized in Table 5.1.

Status of Waste Management

5.6 Spoil generated from TBM excavation in the Western tunnel was delivered by the tunnel conveyor system to the barge berthed at the jetty. If there was no barge at the jetty or after 21:00 hours, the spoil would be directed to the TBM Spoil Basin for temporary storage. The spoils would be transferred to a side conveyor using a backhoe for discharge onto the next barge or in the following day. In the Eastern tunnel and adits, the spoil materials were

collected by means of dump trucks which transported the materials to the Western Portal. The spoil materials from the Eastern tunnel and adits were then disposed of either directly into the barges at the ramp jetty, or temporarily stored in the Adit Spoil Basin for later handling. The barges took the spoil materials to other projects (in Mainland China and in Hong Kong) for re-use.

Adit spoil handling arrangements in the Western Portal

- 5.7 The spoils generated during adit excavation (drill-and-blast) were delivered by trains to the Adit Spoil Basin at the tunnel portal. The adit spoils were transferred to a dump truck by means of a backhoe. The dump truck was then discharge the adit spoils onto the barge at the ramp jetty. The mitigation measures for the spoil handling works at Western Portal are presented in Section 5.22.
- 5.8 The details of site arrangements on the delivery and handling of excavated materials, particularly the Western Portal is provided in the **Annex I** to this report.

Two Blasts Per Day in Western Adits

- Blasting works were increased to two times per day to ensure timely completion of the Project, especially when unexpected ground conditions are encountered during adit excavation. Two blasts per days are planned initially for the Adits leading to Intake HKU1, W10 and P5. The proposal of two blasts per day in Western Adits is provided in **Annex II** to this report.
- 5.10 During this reporting period, a total 10 nos. of dump trucks of waste were delivered to SENT landfill, 127 and 1 trips of C&D waste were delivered to Chai Wan Public Barging Point and TKO Fill Bank respectively. Both the trip ticket system and chit accounting system for disposal of waste were operating smoothly to date. 2 trucks overloading case was recorded during this reporting period (one case was within the 105% allowable buffer weight and one case was over the 5% allowable buffer weight). No disposal of inert C&D material to public sorting facilities and no dump truck without cover were reported from CEDD. In respect of the dump truck cover, DNJV keeps on take record photos and inspection to ensure that all dump trucks have fully covered the skip before leaving the site.
- 5.11 The rock materials from the Eastern Portal and Western Portal were received by the alternative disposal sites at ZhongShan. Some of the tunnel spoils from Eastern Tunnel and adits were also received by Leighton site at Ocean Park and in a residential development site at No. 1 Gough Hill Road, the Peak which was started from 24th September 2010.
- 5.12 The amount of wastes generated by the activities of the Project during the reporting month is shown in **Appendix N**.

Table 5.1 Summary of Environmental Licensing and Permit Status

Permit No. Valid Period Details		Dotoils	Status		
1 Clinic 140.	From To Details		Details	Status	
Environmental Permit (EP)					
FEP-01/272/2007/B	25/6/09	N/A	Construction of a 6.25m-7.25m in diameter and about 11 km long underground main drainage tunnel, 2 portals and a series of connecting adits and drop shafts.		
Effluent Discharge Lic	ense				
EP860/W10/XY0175	23/06/08	30/06/13	Industrial discharge (Area of Mount Butler Office)	Valid	
EP860/W10/XY0177	23/06/08	30/06/13	Industrial discharge (Eastern Portal Site)	Valid	
EP820/W9/XT086	22/07/08	31/07/13	Industrial discharge (Western Portal Site)	Valid	
WT00005864-2010	20/01/10	31/01/15	Industrial discharge (Western Portal Site)	Valid	
EP860/W10/XY0183	19/11/08	30/11/13	Industrial discharge (Intake W0, Stubbs Road, Wan Chai, HK)	Valid	
WT00003372-2009	-	30/4/14	Industrial discharge (Intake SM1)	Valid	
WT00003737-2009	-	31/5/14	Industrial discharge (Intake MB16)	Valid	
WT00004126-2009		31/5/14	Industrial discharge (Intake HKU1)	Valid	
WT00003738-2009	-	31/5/14	Industrial discharge (Intake THR2)	Valid	
WT00004270-2009	-	31/7/14	Industrial discharge (Intake PFLR1)	Valid	
WT00004806-2009	-	30/09/14	Industrial discharge (Intake E7)	Valid	
WT00004808-2009	-	30/09/14	Industrial discharge (Intake MBD2)	Valid	
WT00004885-2009	-	30/09/14	Industrial discharge (Intake RR1)	Valid	
WT00005135-2009	-	31/10/14	Industrial discharge (Intake W10)	Valid	
WT00005374-2009	-	30/11/14	Industrial discharge (Intake P5)	Valid	
WT00005376-2009	-	30/11/14	Industrial discharge (Intake TP4)	Valid	
WT00005357-2009	-	30/11/14	Industrial discharge (Intake W5) Val		
WT00005588-2009	-	31/12/14	Industrial discharge (Intake TP5)	Valid	
WT00005643-2009	-	31/12/14	Industrial discharge (Intake E5A)	Valid	
WT00005754-2010	-	31/01/15	Industrial discharge (Intake W8)		
WT00005954-2010	-	28/02/15	Industrial discharge (Intake TP789) Valid		
WT00005915-2010	-	31/01/15	Industrial discharge (Intake E5B) Valid		
WT00006102-2010	-	28/02/15			
WT00006415-2010	-	30/04/15	Industrial discharge (Intake MA15)	Valid	
WT00006420-2010	-	30/04/15	Industrial discharge (Intake MA17)	Valid	
WT00006428-2010	-	30/04/15	Industrial discharge (Intake BR6)	Valid	
WT00006609-2010	-	31/05/15	Industrial discharge (Intake HR1)	Valid	
WT00006559-2010	-	30/04/15	Industrial discharge (Intake CR1)	Valid	
WT00006929-2010	-	30/06/15	Industrial discharge (Intake W1)	Valid	
WT00006418-2010	-	30/06/15	Industrial discharge (Intake MA14)	Valid	
WT00006865-2010	-	30/06/15	Industrial discharge (Intake BR5)	Valid	
WT00007039-2010	-	31/07/15	Industrial discharge (Intake DG1)	Valid	
WT00007042-2010	-	31/07/15	Industrial discharge (Intake W3)	Valid	
WT00007043-2010	-	31/07/15	Industrial discharge (Intake GL1)	Valid	
WT00007130-2010	-	31/07/15	Industrial discharge (Intake BR4)	Valid	
WT00007139-2010	-	31/07/15	Industrial discharge (Intake BR6) – SMH17	Valid	
WT00007319-2010	-	31/08/15	Industrial discharge (Intake B2)	Valid	
Registration of Chemi	cal Waste Pr				
5213-148-D2393-02		N/A	Chemical waste types: Spent oil	Valid	
5213-172-D2393-01		N/A	Chemical waste types: Spent oil	Valid	
Construction Noise Pe	rmit (CNP)		·		

Permit No.	Valid	Period	- Details	Status	
Termit 140.	From	То	Details	Status	
GW-RS0734-10	25/08/10	24/02/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at Hong Kong West	Valid	
GW-RS0125-11	24/02/11	23/08/11	Drainage Tunnel (Eastern Portal) (DSD Contract No. DC/2007/10), Tai Hang Road, Causeway Bay, Hong Kong.		
GW-RS1054-10	14/12/10	13/02/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at Hong Kong	Valid	
GW-RS0066-11	14/02/11	13/04/11	West Drainage Tunnel (Western Portal), Cyberport Road, Cyberport, Hong Kong (DSD Contract No. DC/2007/10).		
GW-RS0733-10	19/08/10	18/02/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at a construction site of	Valid	
GW-RS0149-11	19/02/11	18/08/11	"Hong Kong West Drainage Tunnel" near Stubbs Road Garden, Wan Chai, Hong Kong		
GW-RS0699-10	22/08/10	21/02/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at Smithfield Road outside Mei Wah Mansion, Kennedy Town, Hong Kong.	Valid	
GW-RS0710-10	19/08/10	18/02/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at Section of Pokfulam	Valid	
GW-RS0167-11	19/02/11	18/08/11	Road (near Football Field, Pokfulam Road Playground), Hong Kong	vanu	
GW-RS0995-10	30/11/10	30/05/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at outside Hongkong Electric Centre, Kennedy Road, Hong Kong	Valid	

Permit No.	Valid Period		Details	Status
1 Clinic 140.	From	То	Details	Status
GW-RS1071-10	09/12/10	08/06/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at Junction of Magazine Gap Road and May Road, Midlevels, Hong Kong.	Valid
GW-RS0147-11	20/02/11	27/03/11	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at Junction of Magazine Gap Road and May Road, Mid-levels, Hong Kong.	Valid

Implementation Status of Environmental Mitigation Measures

5.13 During site inspections in the reporting month, no non-conformance was identified. ET weekly site inspections were carried out during the reporting month and the observations and recommendations are summarized in Table 5.2.

 Table 5.2
 Observations and Recommendations of Site Inspections

Parameters	Date	Observations and Recommendations	Follow-up	
Air Quality	18/02/2011	Dust generation was observed during the grouting works at PFLR1. The Contractor was reminded to provide three-side enclosure with top shelter to avoid dust dispersion.	Rectification/improvement was observed during the follow-up audit session.	
Reminders	10/02/2011	The Contractor was reminded of the followings: - Clear the oil leakage from the mobile crane at Intake PFLR1.	Rectification/improvement was observed during the follow-up audit session.	
	10/02/2011	The Contractor was reminded of the followings: - Provide sedimentation facilities at Intake B2.	Rectification/improvement was observed during the follow-up audit session.	
	10/02/2011	The Contractor was reminded of the followings: - Ensure the site discharge from the sedimentation tank comply with WPCO licenses at Intake BR6.	Rectification/improvement was observed during the follow-up audit session.	
	10/02/2011	The Contractor was reminded of the followings: - Provide sand bag/concrete bund to protect the existing drain at Intake DG1.	Rectification/improvement was observed during the follow-up audit session.	
10/02/2011		The Contractor was reminded of the followings: - Clear the deposited silt at the wheel washing bay at Intake GL1.	Rectification/improvement was observed during the follow-up audit session.	
18/02/	10/02/2011	The Contractor was reminded of the followings: - To repair the damage part of the drip tray at Intake E5A.	Rectification/improvement was observed during the follow-up audit session.	
	18/02/2011	The Contractor was reminded of the followings: - Ensure the site discharge from the sedimentation tank comply with WPCO license at Intake BR6.	Rectification/improvement was observed during the follow-up audit session.	
	18/02/2011	The Contractor was reminded of the followings: - To clear the diesel oil within the u-channel at GL1.	Rectification/improvement was observed during the follow-up audit session.	
	18/02/2011	The Contractor was reminded of the followings: - To clear the deposited mud inside the sedimentation tank at THR2.	Rectification/improvement was observed during the follow-up audit session.	
	18/02/2011	The Contractor was reminded of the followings: - To clear the discarded leaves inside the wheel washing facility at MBD2.	Rectification/improvement was observed during the follow-up audit session.	
	18/02/2011	The Contractor was reminded of the followings: - The air compressor should be provided with valid noise label at PFLR1.	Rectification/improvement was observed during the follow-up audit session.	

Parameters	Date	Observations and Recommendations	Follow-up
	18/02/2011	The Contractor was reminded of the followings: - The sedimentation facility should be provided at M3.	Follow-up action was needed for the item.
	24/02/2011	The Contractor was reminded of the followings: - Clear the stagnant water regularly at Eastern Portal.	Rectification/improvement was observed during the follow-up audit session.
	24/02/2011	The Contractor was reminded of the followings: - Cleat the oil stain at underneath the mobile crane at E5A.	Rectification/improvement was observed during the follow-up audit session.
	24/02/2011	The Contractor was reminded of the followings: - Provide sand bag temporarily at MB16 for avoiding the silty water direct to the gully.	Rectification/improvement was observed during the follow-up audit session.
	24/02/2011	The Contractor was reminded of the followings: - Clear the discarded leaves along the uchannel at MBD2.	Rectification/improvement was observed during the follow-up audit session.

- 5.14 The monthly IEC audit was carried out on 24th February 2011, the observations were recorded and they are presented as follows:
- 5.15 The last observations were recorded by IEC on 28th January 2011.

24th February 2011

Observations:

- Some stagnant water was observed at EP near security guard and surface channel. The Contractor was requested to clear stagnant water.
- Oil stains were observed under mobile crane at MB16 and E5A. The Contractor was requested to clear the stains and reminded to implement measures for oil spilling during refilling process and operation.
- Wastewater was observed flowing into gullies upon unloading cement at MB16. The Contractor was requested to provide sand bags around gullies in order to prevent wastewater flowing into public drain.

Reminder:

• The Contractor was reminded to regular clear rubbish / leaves deposited in surface channels in order to prevent channel blockage.

Non-compliance Recorded during Site Inspections

5.16 No non-compliance was recorded in the reporting month.

Summary of Mitigation Measures Implemented

5.17 The Contractor has implemented the mitigation measures as recommended in the EIA and the updated EM&A Manual in the reporting period except those mitigation measures not applicable at this stage. Status of the implementation of mitigation measures is presented in Table 1.2 and **Appendix J**.

- Design and Construction of Hong Kong West Drainage Tunne Monthly EM&A Report – February 2011
- 5.18 According to the updated EM&A Manual and EP condition, mitigation measures such as noise enclosure and use of quiet PME are required to be implemented.
- 5.19 The actual implementation status of major mitigation measures required under the EP is as follows:
 - Installation of silt curtain during the course of marine works.
 - Provide noise enclosure at Eastern Portal.
 - Submitted the Alternative Plant Inventory (EP condition 2.8(c)).
- 5.20 Alternative plant inventory for the noise performance of plants used in Eastern and Western Portal will be updated from time to time and submitted for ETL's certification and IEC's verification in accordance with EP condition 2.8c.
- 5.21 An updated summary of the EMIS is provided in **Appendix J**.
- 5.22 For the spoil handling works in the Western Portal, the mitigation measures including:
 - Acoustic cover for the main conveyor;
 - Tarpaulin curtains underneath the conveyor enclosure;
 - Sprinkle system underneath the jetty to suppress fugitive dust from unloading spoil;
 and
 - Side curtains at the jetty to shield the unloading dump truck.

Implementation Status of Event Action Plans

5.23 The Event Action Plans for air quality and noise are presented in **Appendix K**.

Eastern Portal

1-hr TSP Monitoring

5.24 No Action/Limit Level exceedance was recorded in the reporting month.

24-hr TSP Monitoring

5.25 No Action/Limit Level exceedance was recorded in the reporting month.

Construction Noise

5.26 No Action/Limit Level exceedance was recorded in the reporting month.

Western Portal

1-hr TSP Monitoring

5.27 No Action/Limit Level exceedance was recorded in the reporting month.

24-hr TSP Monitoring

5.28 No Action/Limit Level exceedance was recorded in the reporting month.

Construction Noise

5.29 One Action Level exceedance was recorded due to the complaint received on 25th February 2011.

Water Quality

5.30 Marine water quality monitoring was temporary suspended starting from 31st October 2009.

Construction Ground Borne Noise

5.31 No Limit Level exceedance was recorded.

Intake DG1

Construction Noise

5.32 No Action/Limit Level exceedance was recorded in the reporting month.

Intake E5A

Construction Noise

5.33 No Action/Limit Level exceedance was recorded in the reporting month.

Intake E7

Construction Noise

5.34 No Action/Limit Level exceedance was recorded in the reporting month.

Intake MA14

Construction Noise

5.35 No Action/Limit Level exceedance was recorded in the reporting month.

Intake PFLR1

Construction Noise

5.36 No Action/Limit Level exceedance was recorded in the reporting month.

Intake RR1

Construction Noise

5.37 No Action/Limit Level exceedance was recorded in the reporting month.

Intake THR2

Construction Noise

5.38 No Action/Limit Level exceedance was recorded in the reporting month.

Intake W0

Construction Noise

5.39 No Action/Limit Level exceedance was recorded in the reporting month.

Intake W5

Construction Noise

5.40 No Action/Limit Level exceedance was recorded in the reporting month.

Intake P5

Construction Noise

5.41 No Action/Limit Level exceedance was recorded in the reporting month.

Intake W8

Construction Noise

5.42 No Action/Limit Level exceedance was recorded in the reporting month.

Intake BR6

Construction Noise

5.43 No Action/Limit Level exceedance was recorded in the reporting month.

Intake GL1

Construction Noise

5.44 One Action levels exceedance was recorded due to the complaint received on 18th February 2011.

Summary of Complaint, Warning, Notification of any Summons and Successful Prosecution

5.45 One environmental complaint was received in the reporting month. For the details, please refer to the following table: -

Complaint No.	Date	Complaint Details
COM-2011-02-186	18 February 2011	The complaint was received from the resident of Green Lane through the ICC on 18th February 2011 about the
		construction noise generated from the plant equipments being operated at Intake GL1 from early in the morning
		and ends at around 19:00 at night.
COM-2011-02-188	25 February 2011	The complaint was received from the resident of Bel Air, Mr Wong, who called hotline at 3am and 4pm on 25 Feb 2011 to complaint about noise. The complaintant refuse to give details on the nosie. He claims that he will report this to the Police and requested DNJV to provide him with copy of CNP.

- 5.46 No warning, summon and notification of successful prosecution was received in the reporting month.
- 5.47 There were a total of 80 project related environmental complaints, no warning, summons and successful prosecution received since the commencement of the Project. The Complaint Log is attached in **Appendix L**.

Monthly EM&A Report – February 2011

6. FUTURE KEY ISSUES

Key Issues for the Coming Month

- Key environmental issues at Eastern and Western Portals, Intake MA16, MBD2, E5A, E5B, E7, PFLR1, RR1, THR2, SM1, W0, W5, P5, M3, TP4, TP5, TP789, HKU1, W10, W3, W8, MA15, MA17, GL1, HR1, W1, DG1, CR1, BR4, BR5, GL1, MA14 and BR6 in the coming month include:
 - Noise from operation of the equipment, especially for rock-breaking activities, piling works and machinery on-site;
 - Dust generation from stockpiles of dusty materials, excavation works and rock breaking activities;
 - Runoff from exposed slope;
 - Wastewater and runoff discharge from site;
 - Regular removal of silt, mud and sand along u-channels and sedimentation tanks;
 - Review and implementation of temporary drainage system for the surface runoff;
 - Proper storage of construction materials on site;
 - Storage of chemicals/fuel and chemical waste/waste oil on site;
 - Watering for rock breaking activity, soil nailing and on haul road;
 - Accumulation of general and construction waste on site.
- 6.2 The tentative program of major site activities and the impact prediction and control measures for the coming two months, i.e. March 2011 to April 2011 are summarized as follows:

Monitoring Schedule for the Next Month

6.3 The tentative environmental monitoring schedules for the next month are shown in **Appendix D**.

Construction Program for the Next Month

6.4 The tentative construction program for the Project is provided in **Appendix M**.

Monthly EM&A Report – February 2011

7. CONCLUSIONS AND RECOMMENDATIONS

Conclusions

7.1 Environmental monitoring works were performed in the reporting month and all monitoring results were checked and reviewed.

1-hr TSP Monitoring

7.2 All 1-hr TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

24-hr TSP Monitoring

7.3 All 24-hr TSP monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

Construction Noise Monitoring

7.4 All noise monitoring was conducted as scheduled in the reporting month. Two Action Level exceedances were recorded due to the complaints received at Western Portal and Intake GL1 respectively.

Construction Ground Borne Noise Monitoring

7.5 All construction ground borne noise monitoring was conducted in the reporting month. No Limit Level exceedance was recorded.

Water Quality

7.6 Marine water quality monitoring was temporary suspended starting from 31st October 2009.

Complaint and Prosecution

7.7 Two environmental complaints and no environmental prosecution were received in the reporting month.

Recommendations

7.8 According to the environmental audit performed in the reporting period, the following recommendations were made:

Air Quality Impact

- To prohibit any open burning on site.
- To regularly maintain the quality of machinery and vehicles on site.
- To implement dust suppression measures on all haul roads, stockpiles, dry surfaces and excavation works.

• To provide hoarding along the entire length of that portion of the site boundary.

Noise Impact

- To inspect the noise sources inside the site.
- To space out noisy equipment and position the equipment as far away as possible from sensitive receivers.
- To provide temporary noise barriers for operations of noisy equipment near the noise sensitive receivers in an appropriate location.


Water Impact


- To prevent any surface runoff discharge into any stream course.
- To review and implement temporary drainage system.
- To identify any wastewater discharges from site.
- To ensure properly maintenance for de-silting facilities.
- To clear the silt and sediment in the sedimentation tanks.
- To review the capacity of de-silting facilities for discharge.
- To divert all the water generated from construction site to de-silting facilities with enough handling capacity before discharge.
- To avoid accumulation of stagnant and ponding water on site.


Waste/Chemical Management


- To check for any accumulation of waste materials or rubbish on site.
- To ensure the performance of sorting of C&D materials at source (during generation);
- To carry out inspection of dump truck at site exit to ensure inert and non-inert C&D materials are properly segregated before removing off site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the site
- To avoid improper handling or storage of oil drum on site.


FIGURES

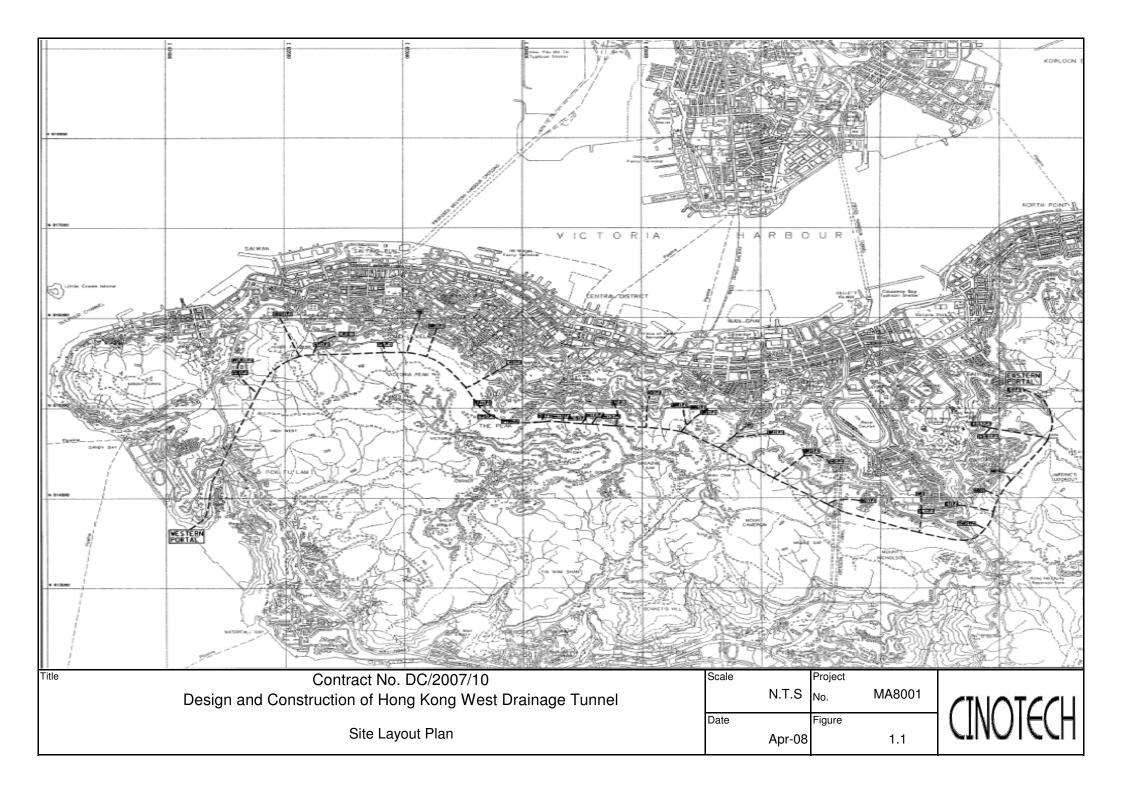


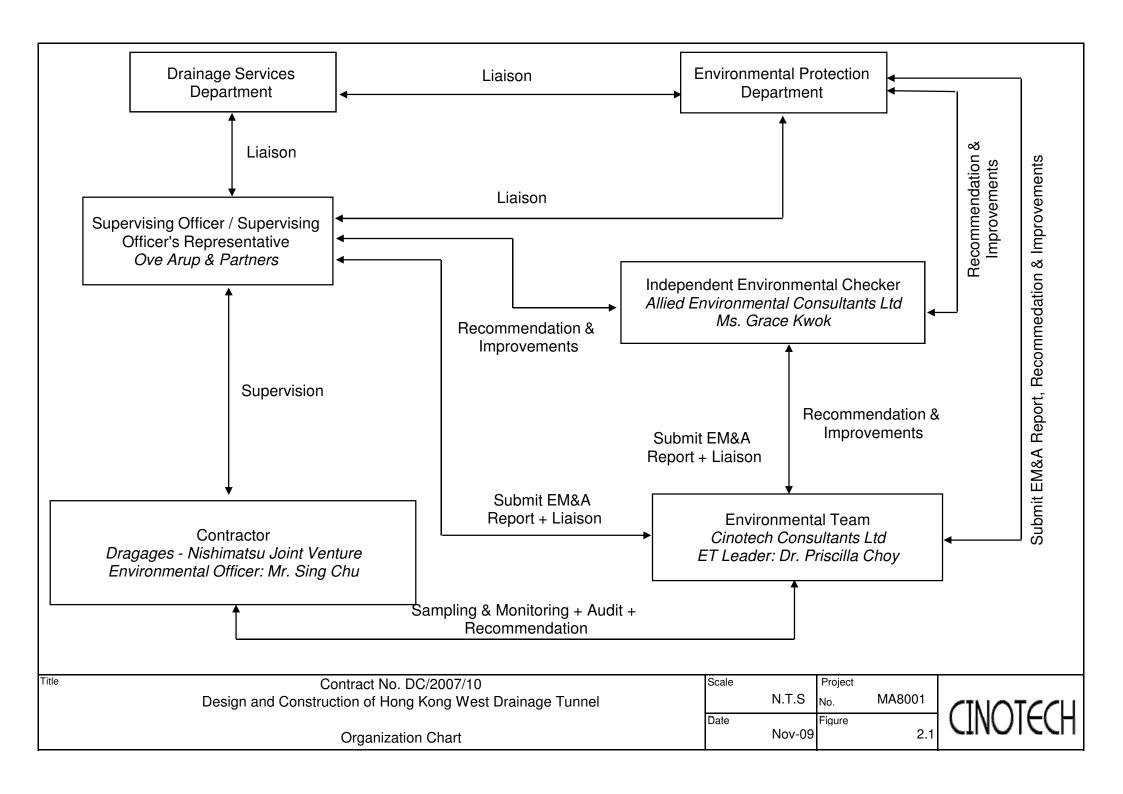

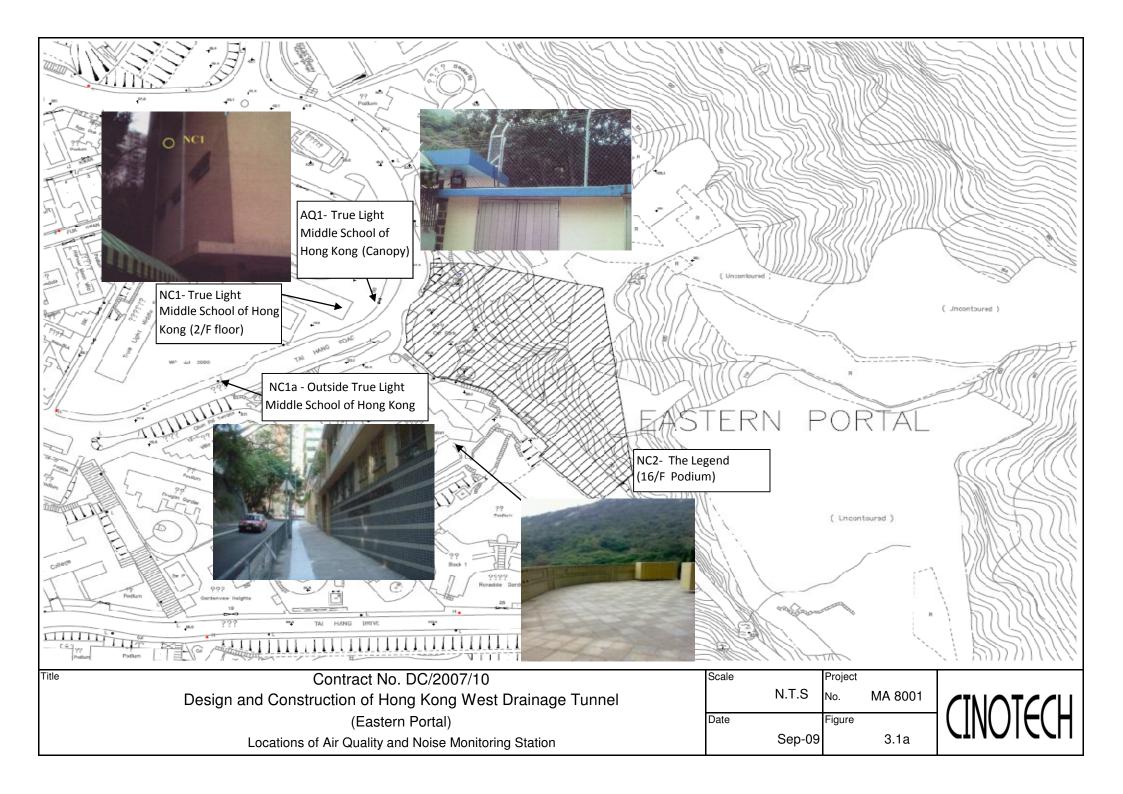


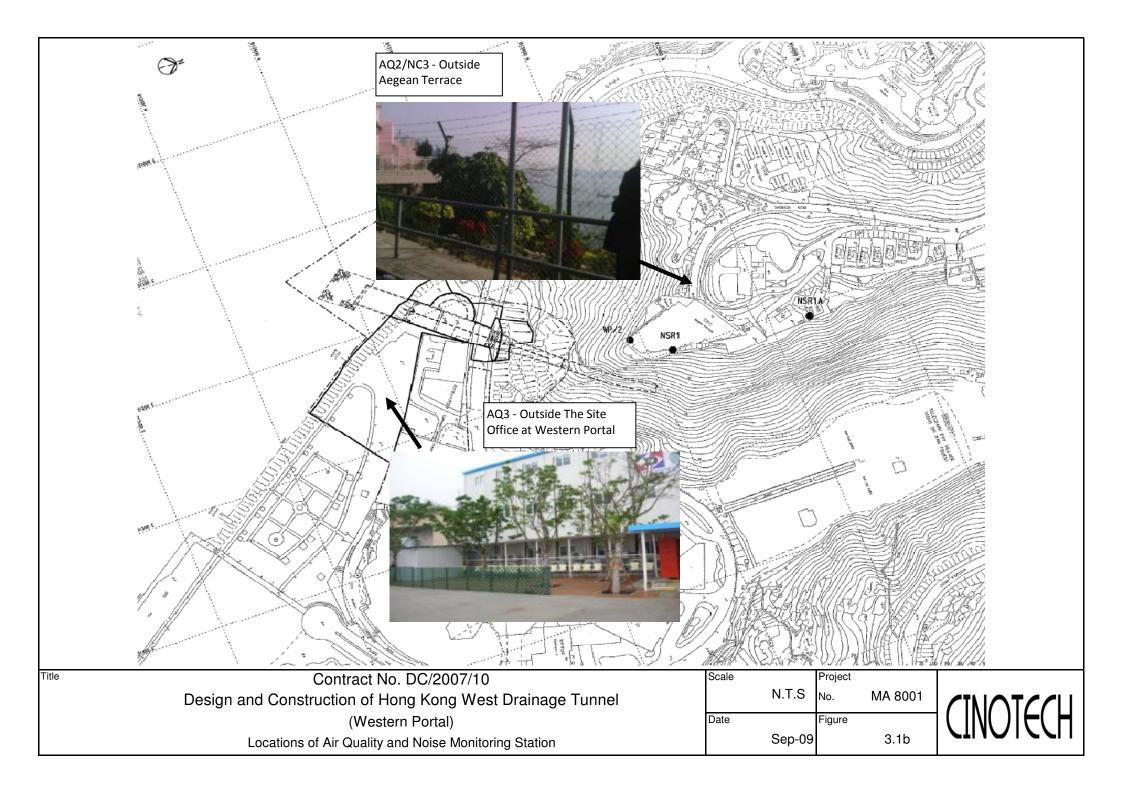


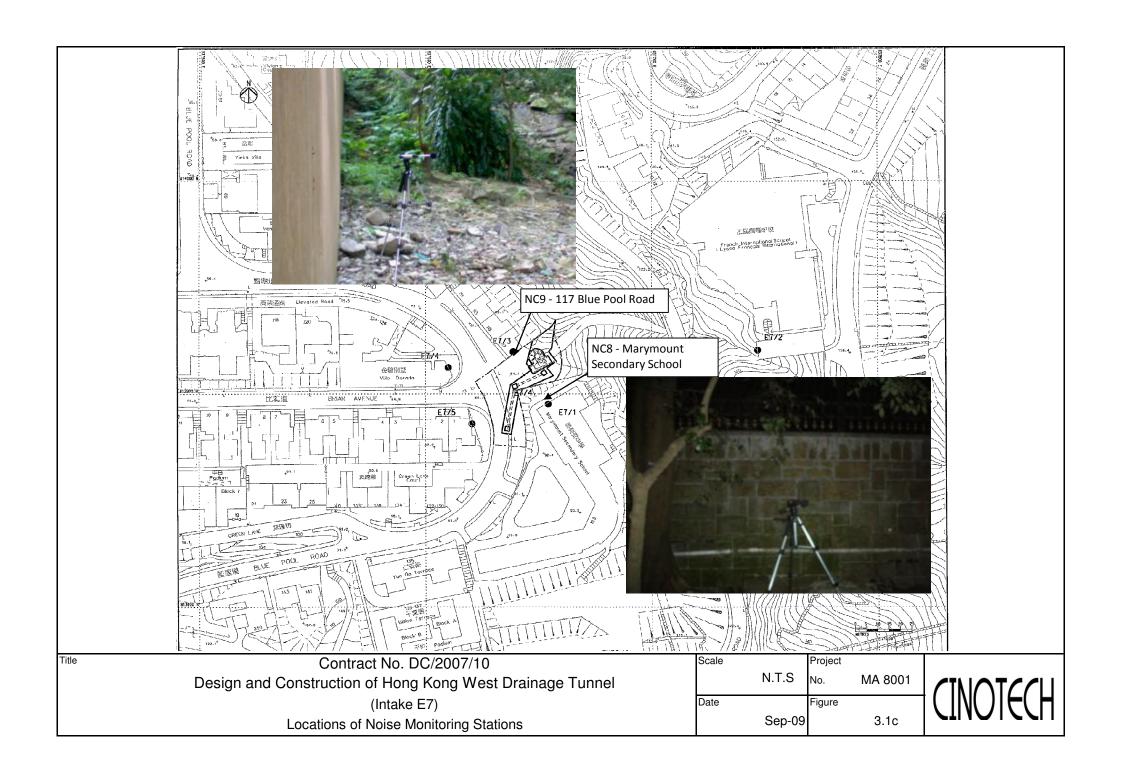


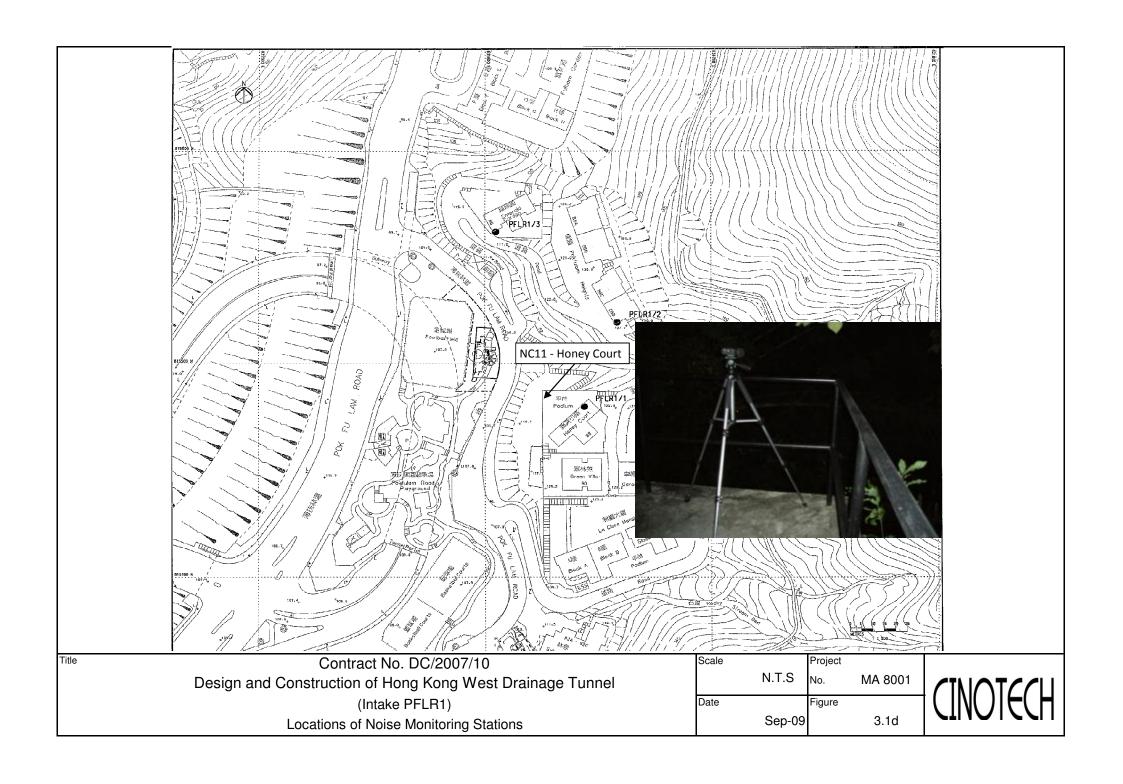





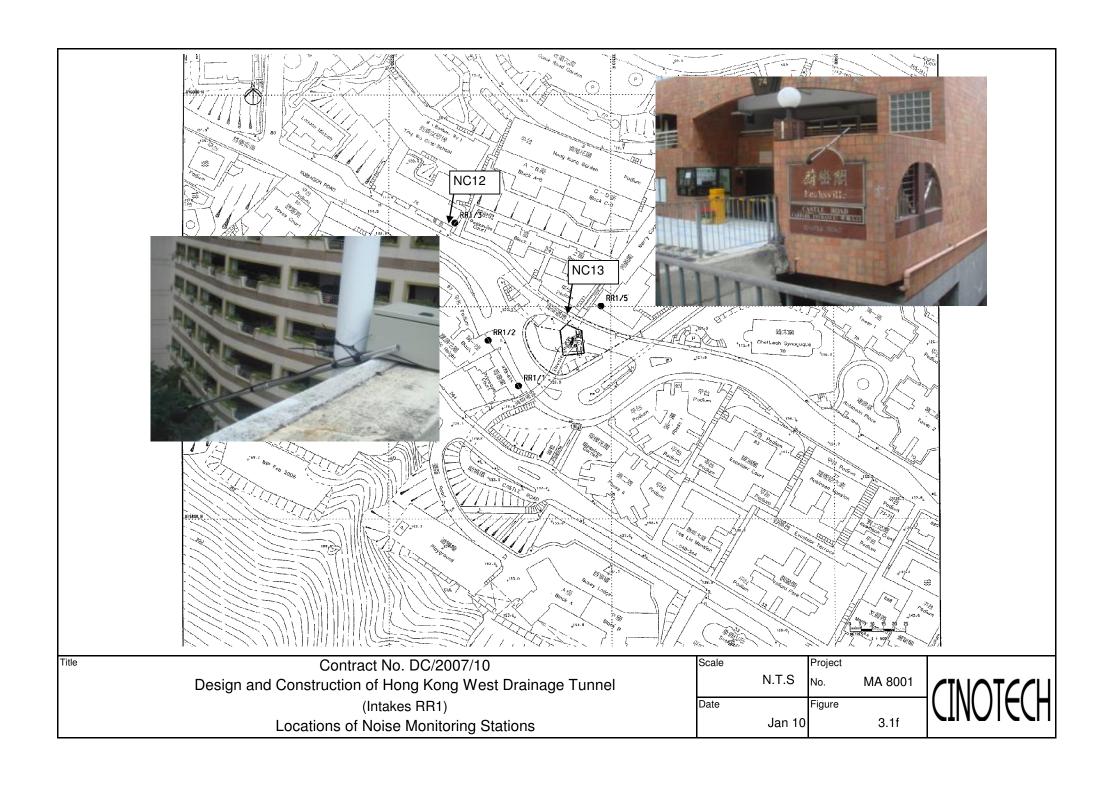


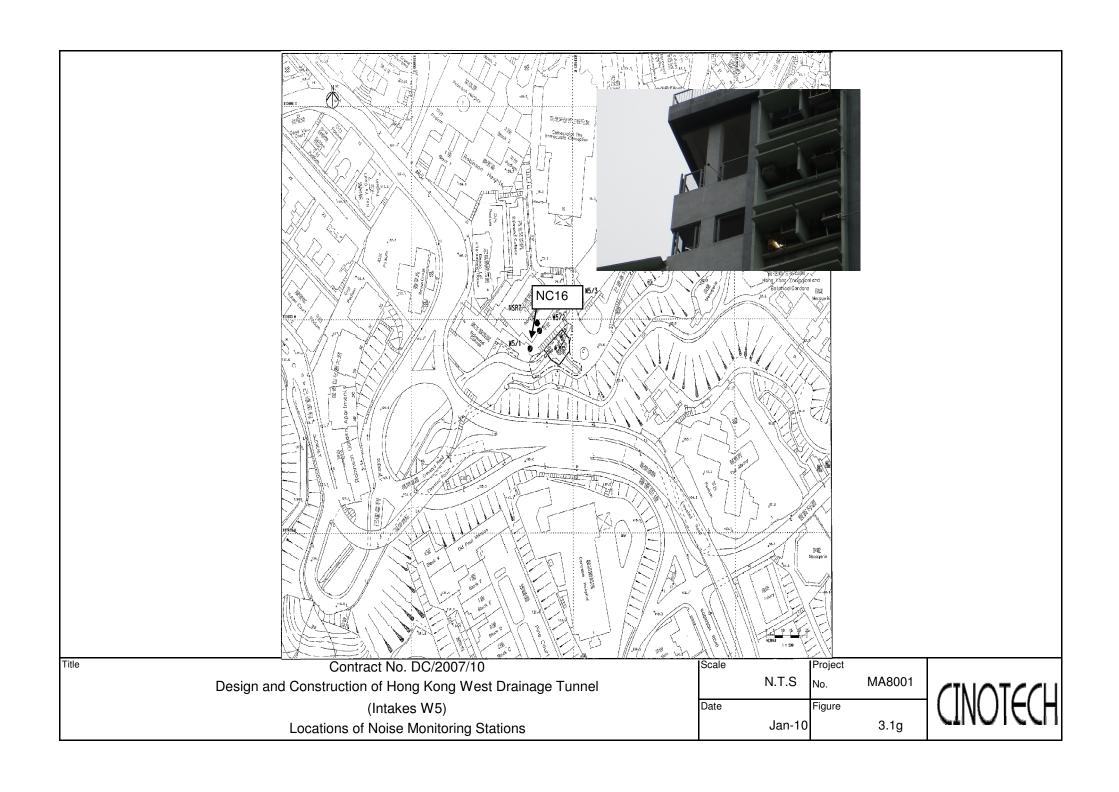


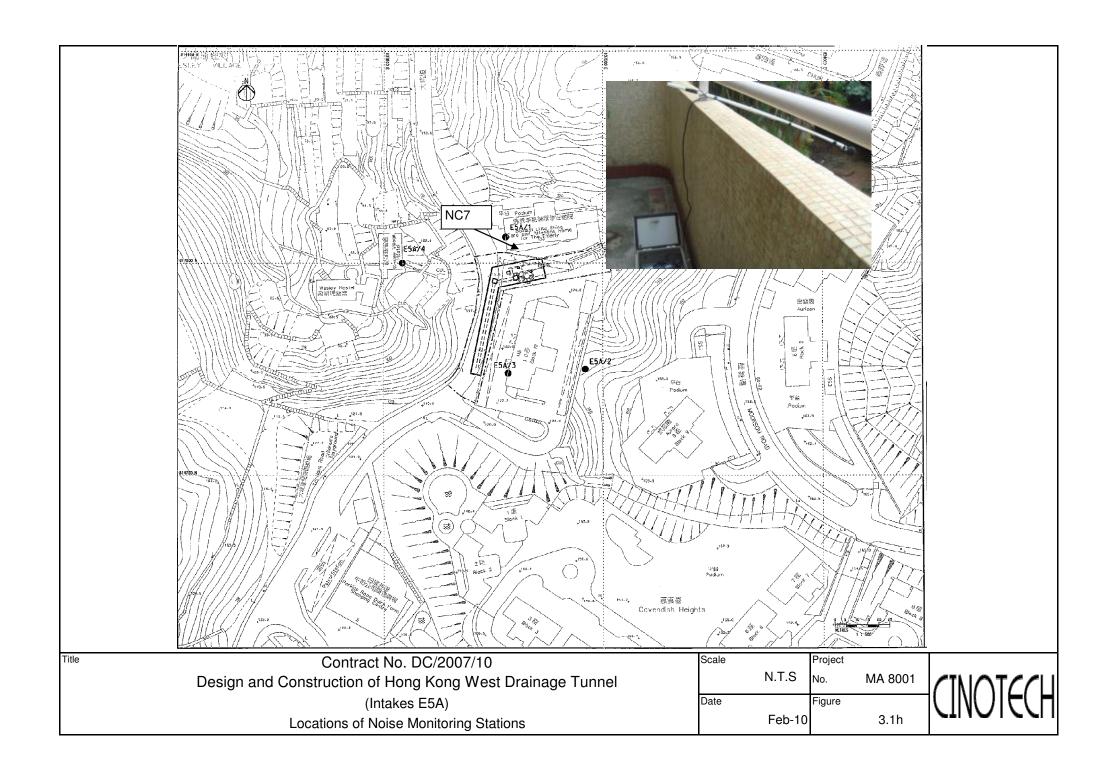


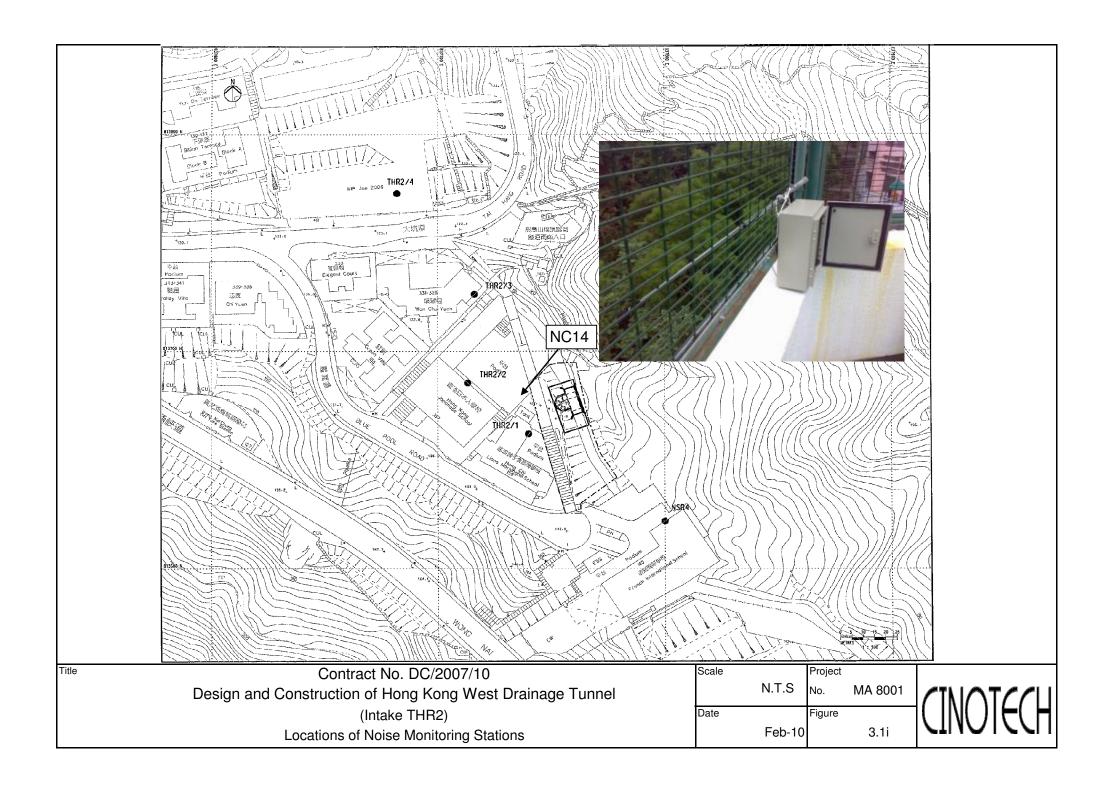


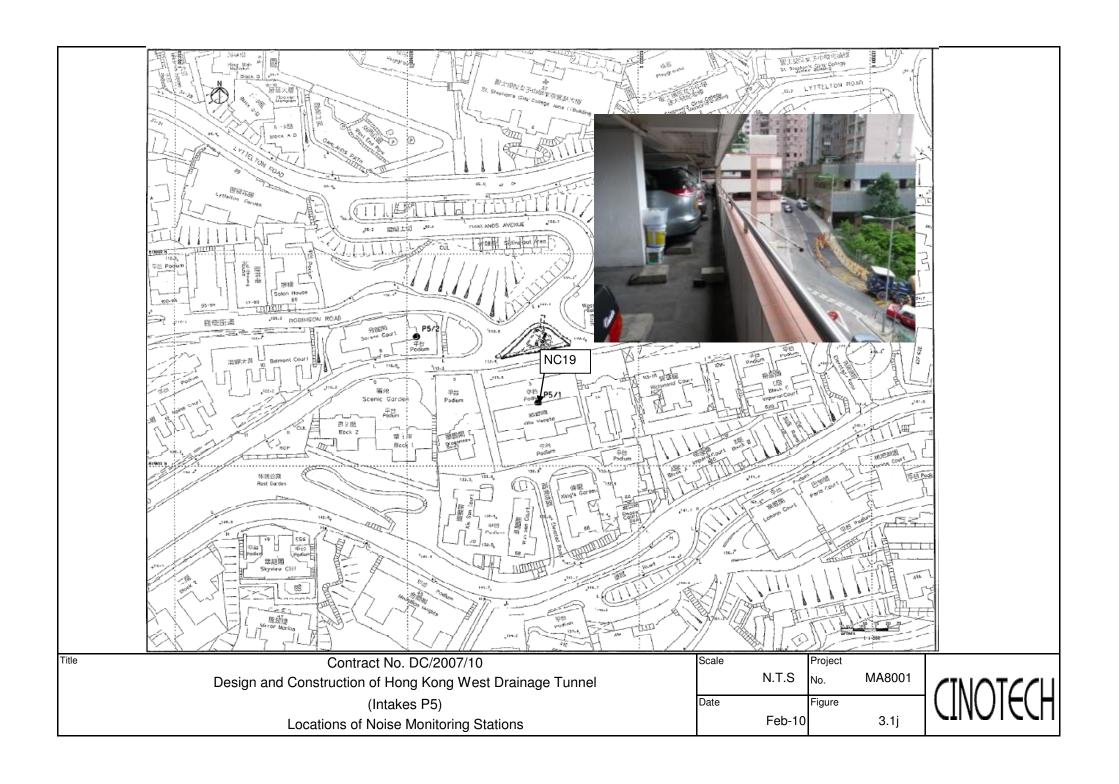


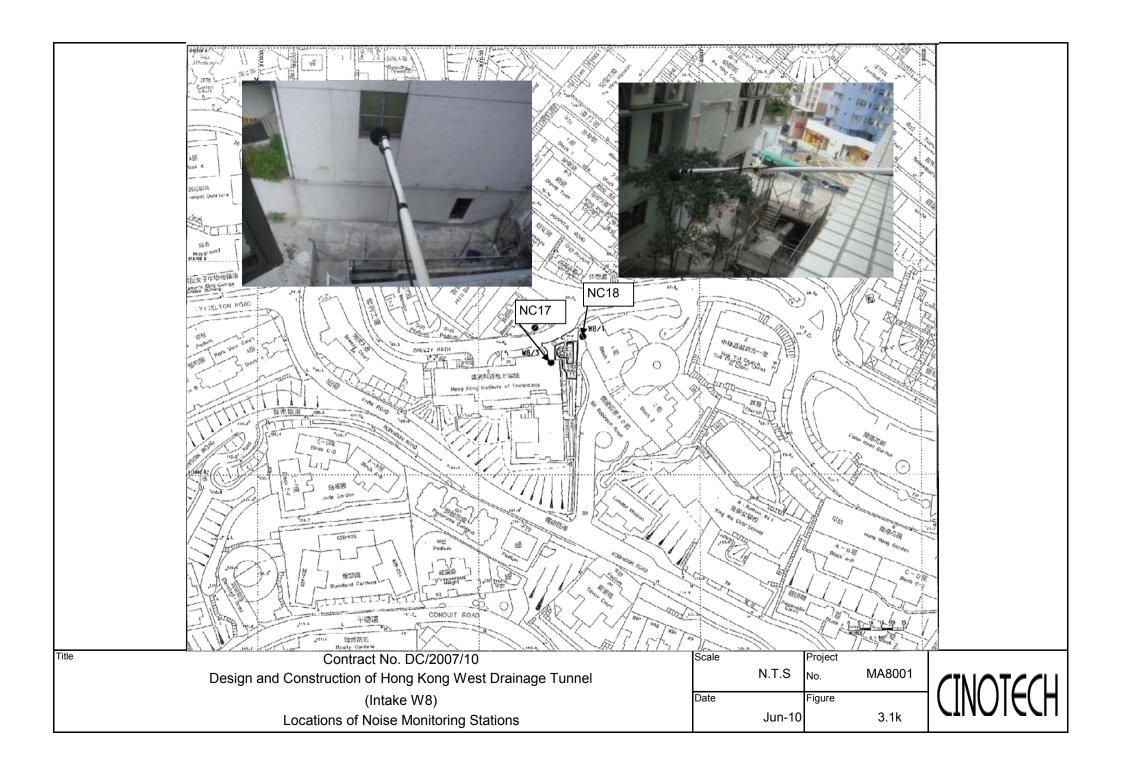

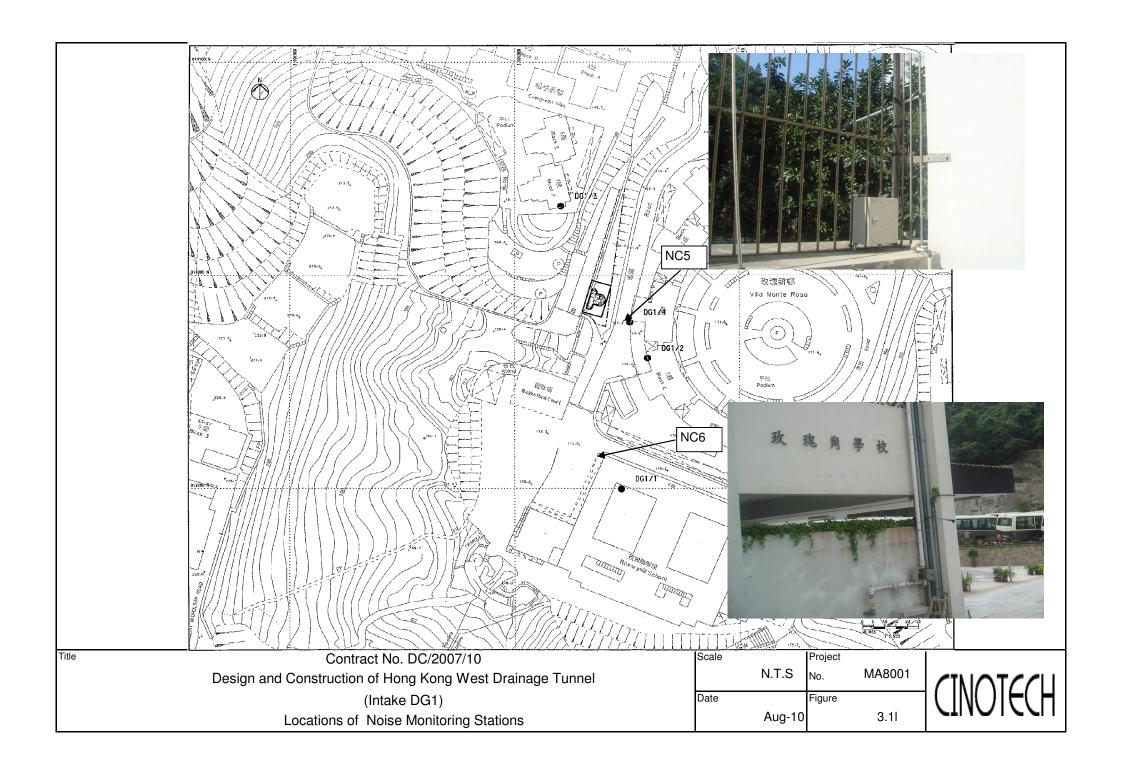


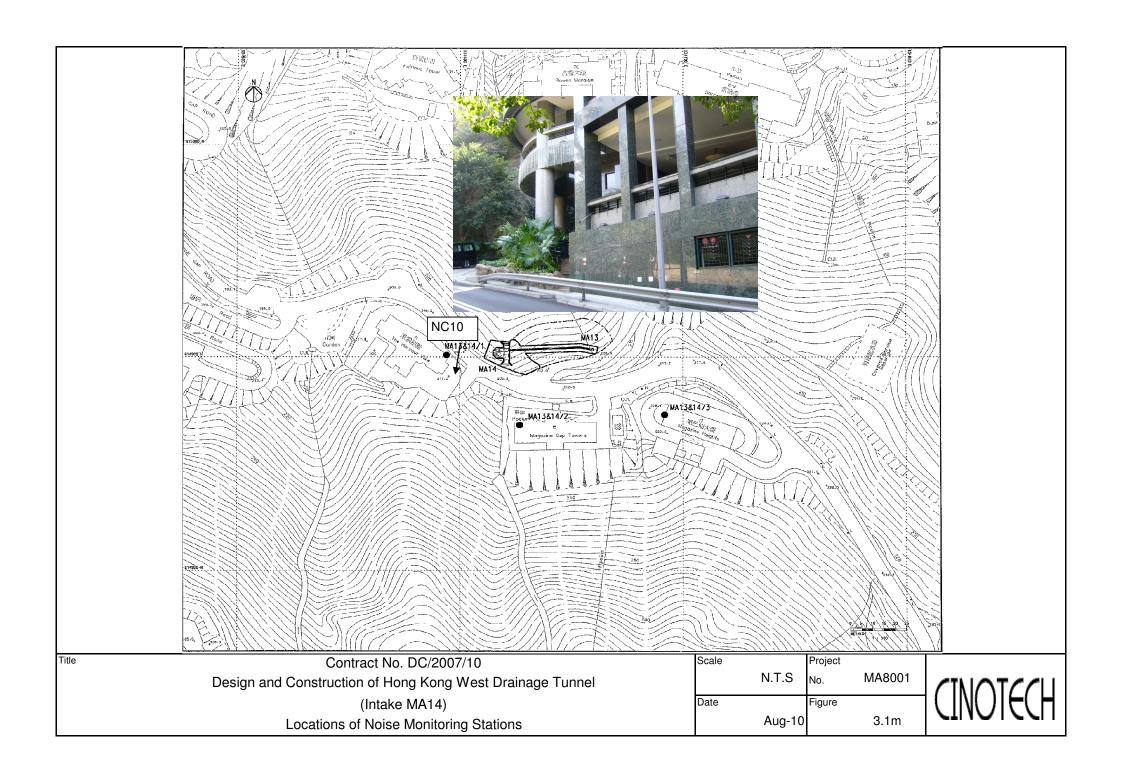

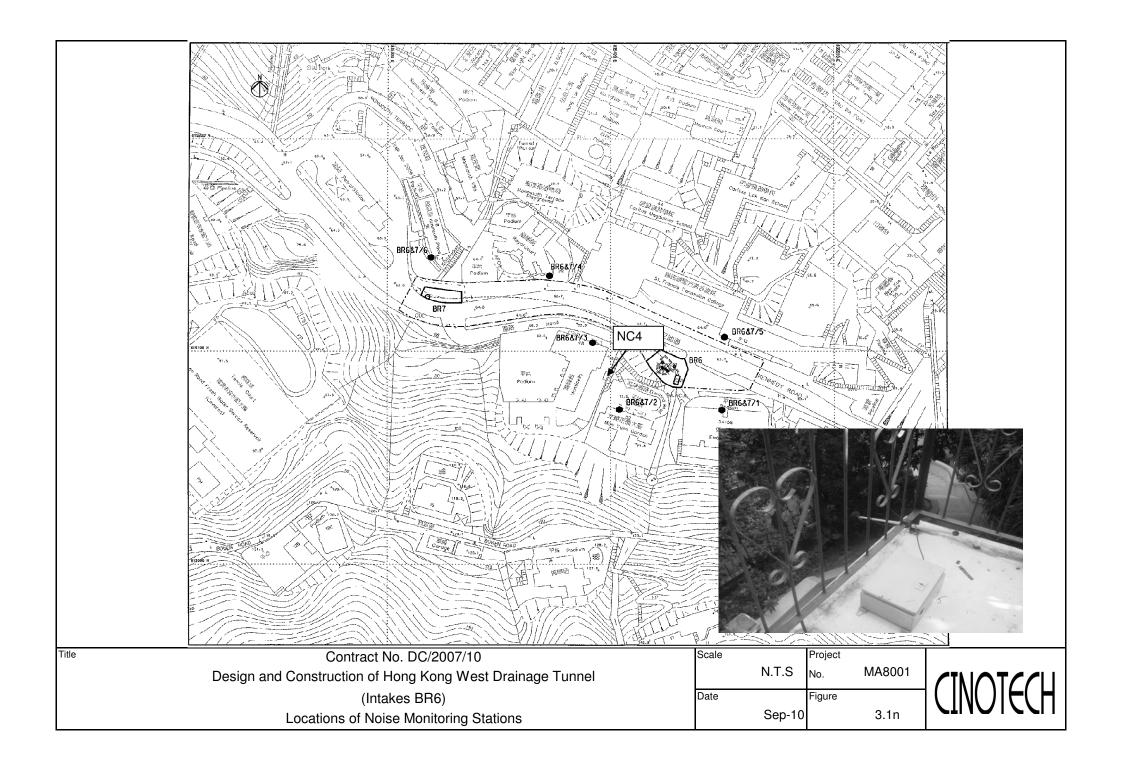

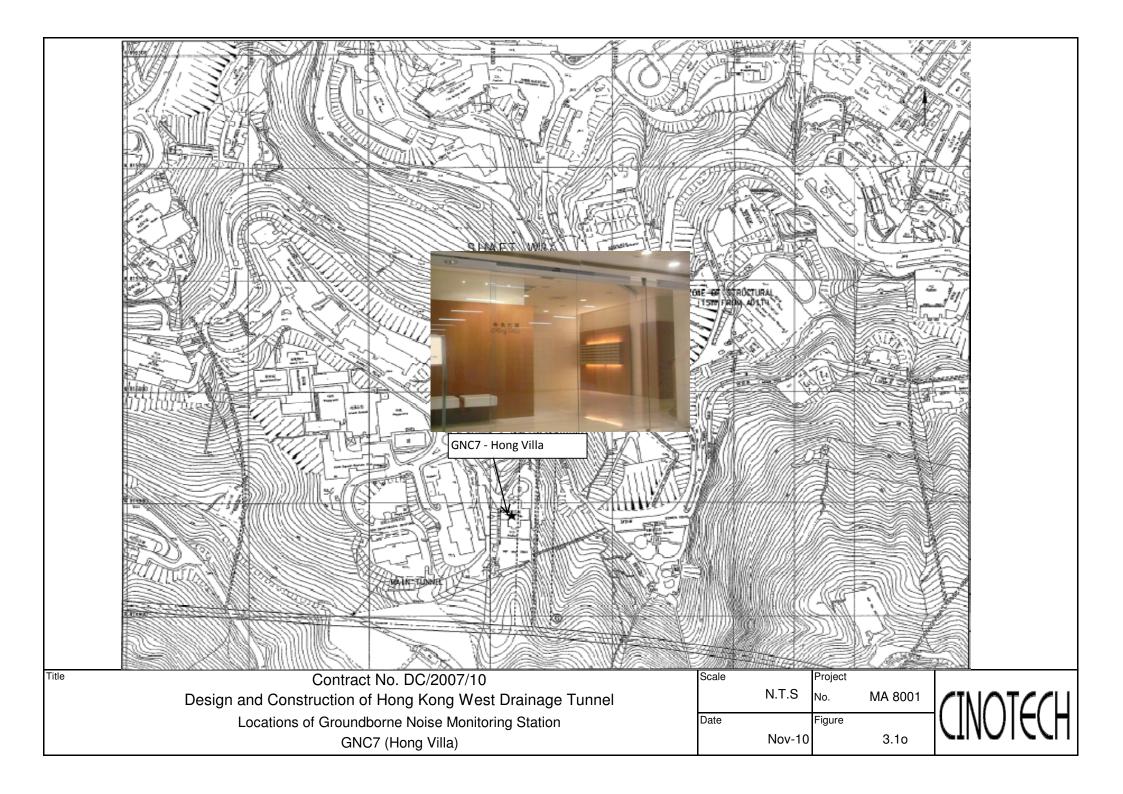



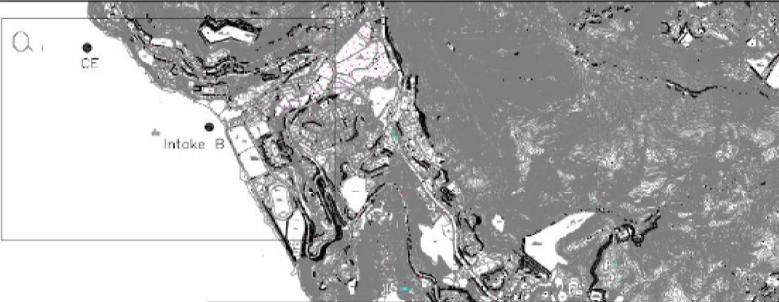

Paint Na	Co-ordinates		
FOIRT NO.	Easting	Westing	
CE	830026	814956	
I1	831088	813654	
15	831105	813582	
CF	831778	812420	
Intake A	831603	813044	
Intake B	830606	814583	



Title


Contract No. DC/2007/10


Design and Construction of Hong Kong West Drainage Tunnel


Locations of Water Quality Monitoring Stations


Scale		Project	
	N.T.S	No.	MA8001
Date		Figure	
	Jun-08		4.1




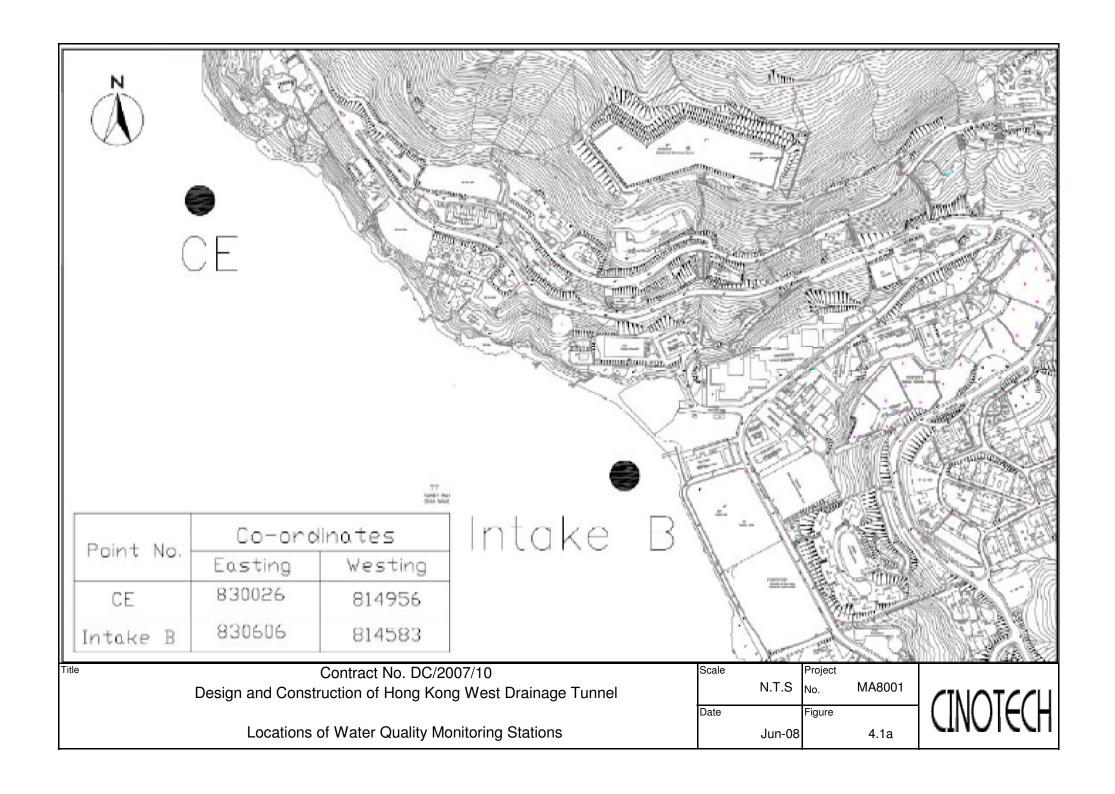


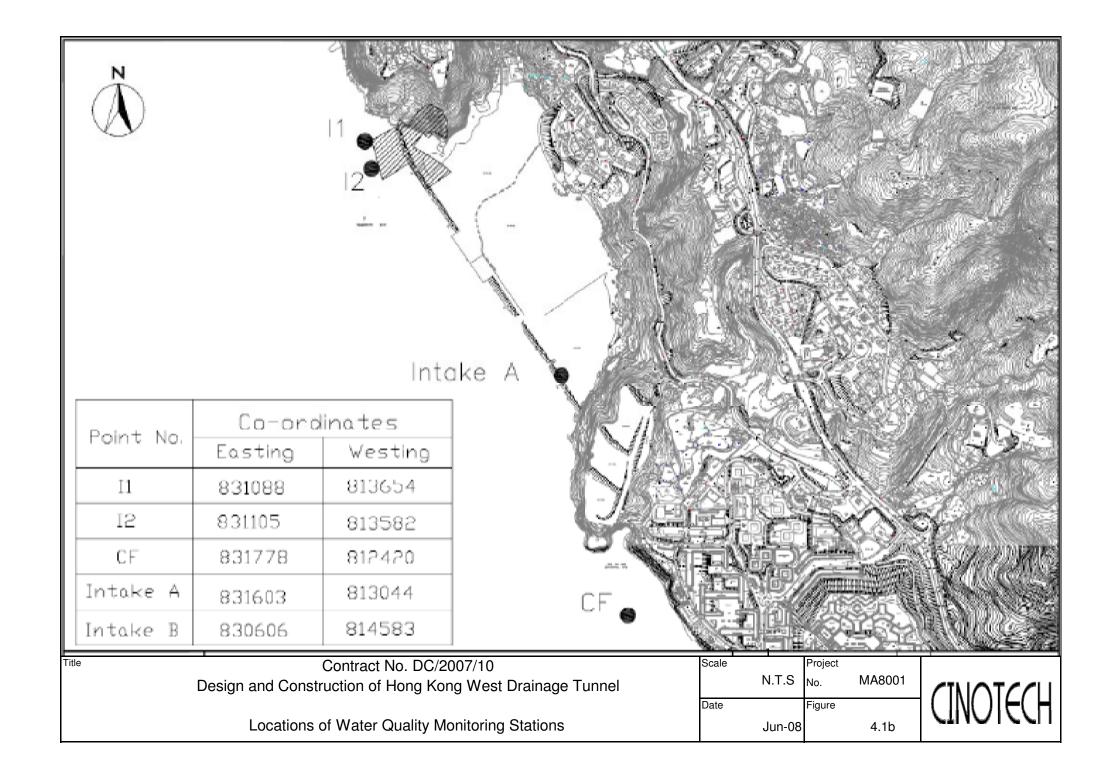


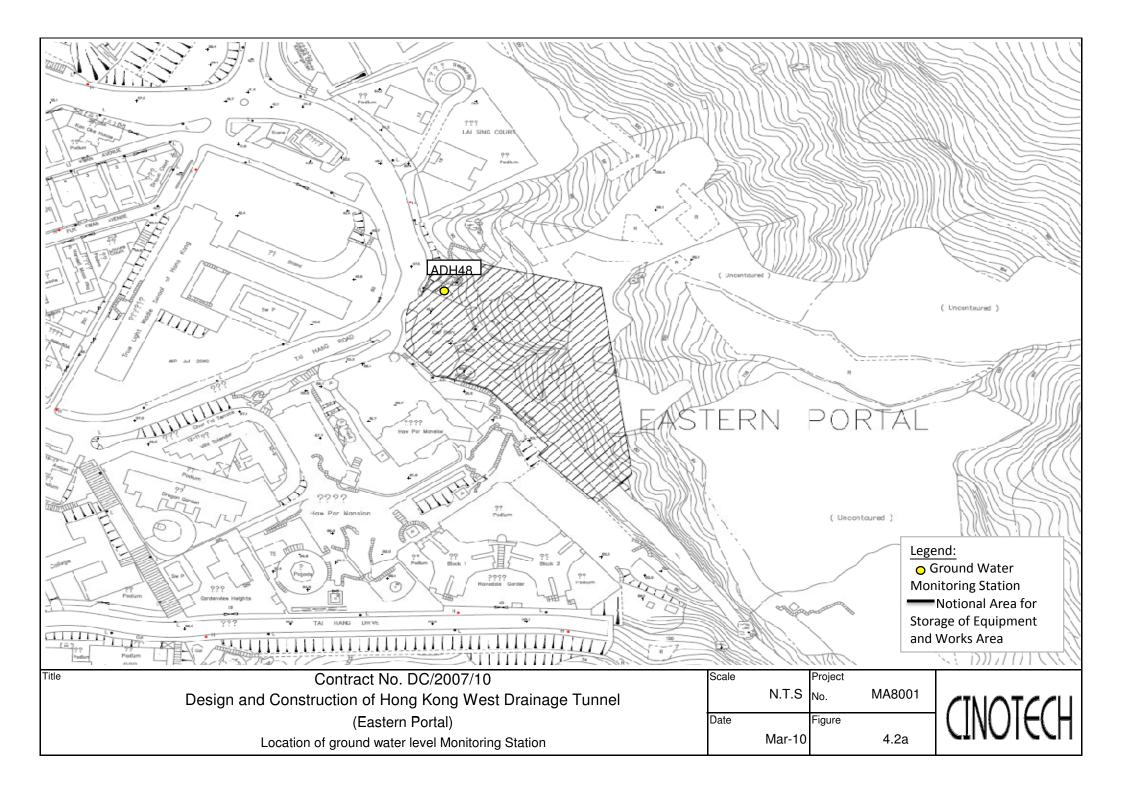

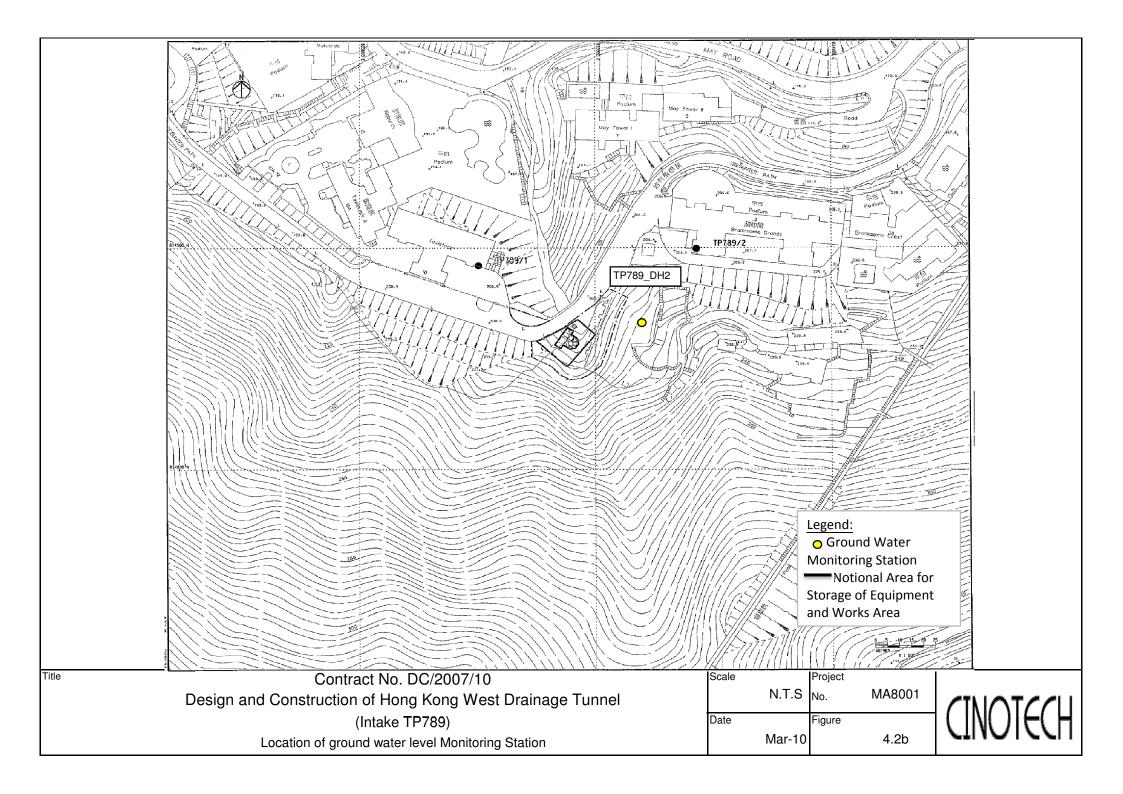

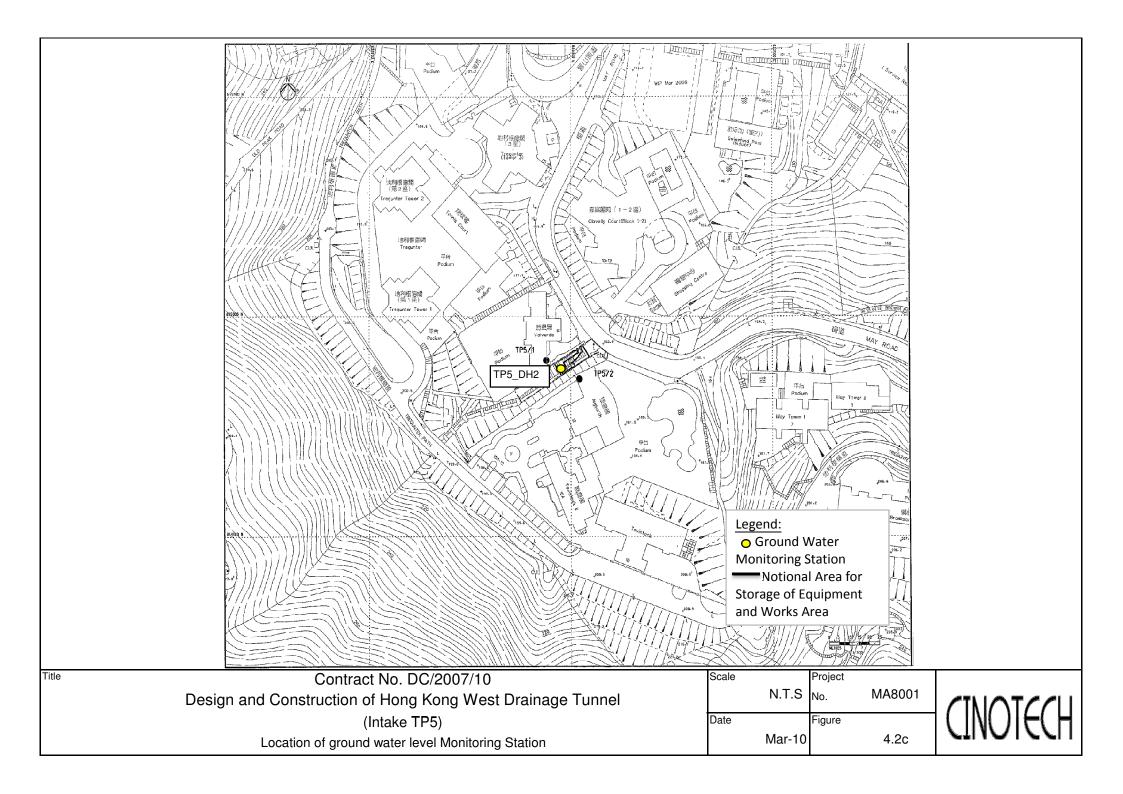

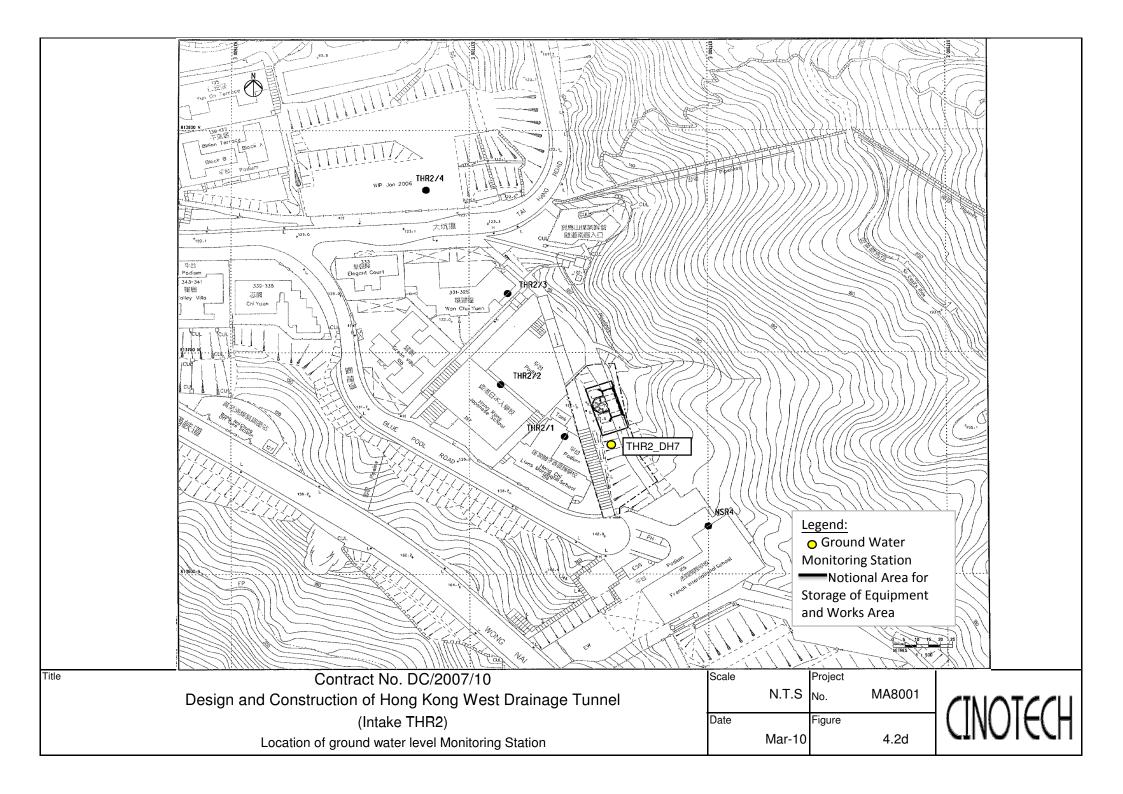

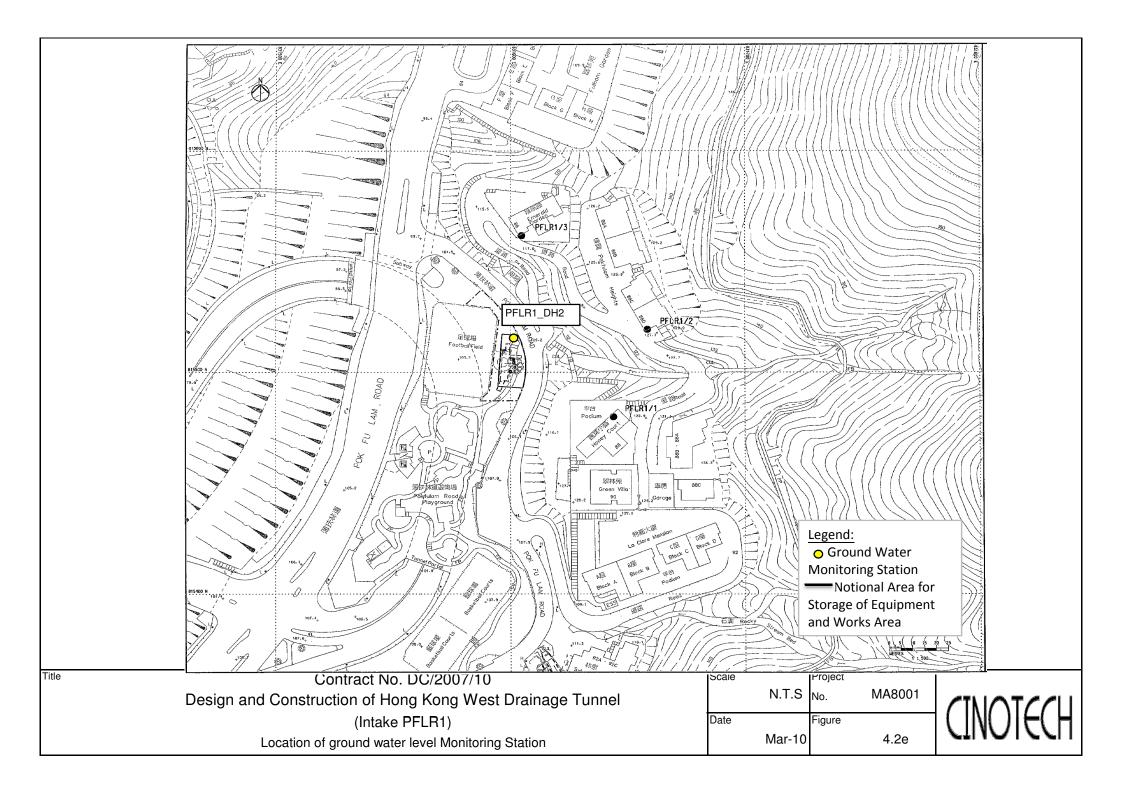

APPENDIX A ACTION AND LIMIT LEVELS

Appendix A - Action and Limit Levels

Table A-1 **Action and Limit Levels for 1-Hour TSP**

Location	Action Level, μg/m ³	Limit Level, μg/m ³
AQ1	345	500
AQ2	321	300

Table A-2 **Action and Limit Levels for 24-Hour TSP**

Location	Action Level, μg/m ³	Limit Level, μg/m ³
AQ1	201	260
AQ3	156	200

Table A-3 **Action and Limit Levels for Construction Noise**

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays		75* dB(A)
0700-2300 hrs on holidays; and 1900-2300 hrs on all other days	When one documented complaint is received	60/65/70** dB(A)
2300-0700 hrs of next day	1	45/50/55** dB(A)

^(*) reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods. (**) to be selected based on Area Sensitivity Rating.

Table A-4 **Action and Limit Levels for Water Quality**

Parar	neter	Action	Limit
DO, mg/L	Surface and Middle	6.3	6.2
	Bottom	6.0	5.8
SS, n	ng/L	or 120% of upstream control station's SS at the same tide of the same day	or 130% of SS readings at the upstream control station at the same tide of same day and specific sensitive receiver water quality requirements
Turbidit	y, NTU	or 120% of upstream control station's turbidity at the same tide of the same day	or 130% of turbidity at the upstream control station at the same tide of same day

APPENDIX B COPIES OF CALIBRATION CERTIFCATES

High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA8001/44/0019 WK Station AQ1 - True Light Middle School of Hong Kong Operator: Date: 7-Jan-11 Next Due Date: 6-Mar-11 Equipment No.: A-01-44 1316 Serial No. Ambient Condition 280.8 Temperature, Ta (K) Pressure, Pa (mmHg) 773.3 Orifice Transfer Standard Information 0.0462 Intercept, bc Equipment No.: A-04-01 Slope, mc -0.0163 me x Qstd + bc = $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ Last Calibration Date: 11-Oct-10 Qstd = $\{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} -bc\} / mc$ Next Calibration Date: 9-Oct-11 Calibration of TSP Sampler Orfice HVS Calibration $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2} Y$ ΔH (orifice), Qstd (CFM) ΔW Point $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ in. of water X - axis (HVS), in. of oil 11.8 77.62 2.90 1 3.57 7.8 9.8 2 3.25 70.77 6.4 2.63 3 7.6 2.86 62.36 5.1 2.35 4 5.2 2.37 51.64 3.3 1.89 5 3.3 1.89 41.21 2.0 1.47 By Linear Regression of Y on X Intercept, bw :______-0.1401 Slope, mw = 0.0393Correlation coefficient* = *If Correlation Coefficient < 0.990, check and recalibrate. Set Point Calculation From the TSP Field Calibration Curve, take Qstd = 43 CFM From the Regression Equation, the "Y" value according to mw x Qstd + bw = $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ Remarks: Conducted by: MK. Tang. Signature: Date:

High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET



						File No.	MA8001/18/001	18
Station	AQ3 - Outside	Site Office (West	ern Portal)	Operator:	WK	·	_	
Date:	7-J	an-11	_	Next Due Date:	6-Mar	-11	•	
Equipment No.:	A-0	01-18		Serial No.	0723		-	
			Ambient	Condition				\neg
Temperati	ire, Ta (K)	280.6	Pressure, P			773.5		
	, ()			(I			
		Oi	rifice Transfer St	tandard Inform	ation			
Equipm	ent No.:	A-04-01	Slope, mc	0.0462	Intercep	t, bc	-0.0163	
Last Calibr	ation Date:	11-Oct-10		mc x Qstd + l	$bc = [\Delta H \times (Pa/76)]$	50) x (298/Ta	ı)] ^{1/2}	
Next Calibi	ration Date:	9-Oct-11		Qstd = {[ΔH	x (Pa/760) x (298	/Ta)] ^{1/2} -bc}	/ mc	
		•	C-lib	6770D CI				
		0**		f TSP Sampler		TING		\dashv
Calibration	ΔH (orifice),		fice	Qstd (CFM)	ΔW	HVS	760) x (298/Ta)] ^{1/2}	$\frac{1}{\mathbf{v}}$
Point	in. of water	[ΔH x (Pa/76)	0) x (298/Ta)] ^{1/2}	X - axis	(HVS), in. of oil		axis	*-
1	11.7	3	3.56	77.33	7.9		2.92	
2	9.8	3	1,25	70.80	6.8		2.71	\Box
3	7.5	2	2.85	61.98	5.0		2,32	
4	5.3	2	2.39	52.16	3.3		1.89	ヿ
5	3.1	1	.83	39.97	2.0		1.47	
Slope , mw = Correlation c	oefficient* = _	0.9 0, check and reca		Intercept, bw : _	- 0.147	17		
			Set Point (Calculation				\dashv
		Curve, take Qstd = e "Y" value accor mw x Q	43 CFM		98/Ta)] ^{1/2}			
Therefore, So	et Point; W = (m	w x Qstd + bw) ²	x (760 / Pa) x (Ta / 298)=	2.27			
Remarks:			1.					
Conducted by: Checked by:	wh. Tang	Signature:	Kw	o~		Date:	7/1/11 7 January o	<u> </u>



Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong.

Tel: 2898 7388 Fax: 2898 7076 Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/A/100504 Date of Issue: Date Received:

2010-05-04

2010-04-30

Date Tested: Date Completed: 2010-04-30 2010-04-30

Next Due Date:

2011-05-03

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: RS232 Integral Vane Digital Anemometer

Manufacturer

: AZ Instrument

Model No.

: 451104

Serial No.

: 9020746

Equipment No.

: A-03-01

Test conditions:

Room Temperature

: 22 degree Celsius

Relative Humidity

: 68%

Pressure

: 101.3 kPa

Methodology:

The anemometer has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

	Reference Set Point	Instrument Readings
Measuring Air Velocity, m/s	2.00	2.00
Temperature, °C	21.0	21.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



WELLAB LIMITED Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T. Hong Kong. Tel: 2898 7388 Fax: 2898 7076 Website: www.wellab.com.hk

TEST REPORT

Description Calibration Orifice

Serial No. Model No. 1536

Date

G25A

11 October 2010

Manufacturer

Thermo Andersen

Temperature, Ta (K)

295

Pressure, Pa (mmHg) 751.5

Plate	Diff.Vol (m ³)	Diff.Time (min)	Diff.Hg (mm)	Diff.H ₂ O (in.)
1	1.00	1.3050	3.8	1.50
2	1.00	0.9250	7.6	3.00
3	1.00	0.8540	8.9	3.50
4	1.00	0.7530	11.4	4.50
5	1.00	0.6210	16.5	6.50

DATA TABULATION

Vstd	(X axis)	(Y axis)
	Qstd	
0.9938	0.7615	1.2240
0.9888	1.0689	1.7311
0.9870	1.1558	1.8698
0.9837	1.3064	2.1201
0.9769	1.5732	2.5481

Y axis= SQRT[H₂O(Pa/760)(298/Ta)]

Qstd Slope (m) = 1.63228

Intercept (b) = -0.01631

Coefficient (r) = 0.99998

Va	(X axis)	(Y axis)
	Qa	
0.9949	0.7624	0.7674
0.9899	1.0701	1.0852
0.9882	1.1571	1.1722
0.9848	1.3079	1.3291
0.9780	1.5749	1.5974

Y axis= SQRT[H2O(Ta/Pa)]

Qa Slope (m) = $\frac{1.02211}{1.02211}$

Intercept (b) = -0.01022

Coefficient (r) = 0.99998

CALCULATIONS

Vstd=Diff. Vol[(Pa-Diff.Hg)/760](298/Ta) Qstd=Vstd/Time Va=Diff.Vol[(Pa-Diff.Hg)/Pa] Qa=Va/Time

For subsequent flow rate calculations:

 $Qstd=I/m{[SQRT(H₂O(Pa/760)(298/Ta))]-b}$

Qa=I/m{[SQRT H₂O(Ta/Pa)]-b}


PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



TEST REPORT

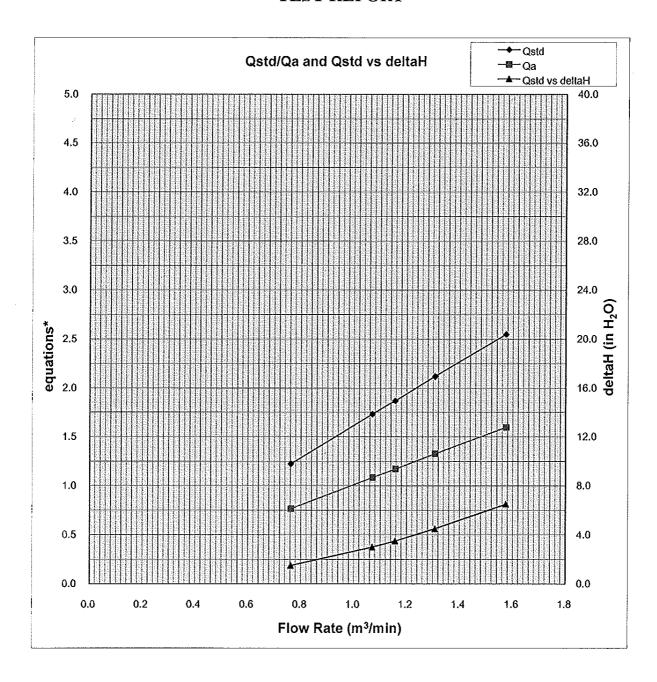

Y-axis equations:

Qstd series: SQRT[\(\Delta H(Pa/Pstd)(Tstd/Ta)]

Qa series: $SQRT[\Delta H(Ta/Pa)]$



WELLAB LIMITED Rms 816, 1516 & 1701, Technology Park,

18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT: Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/110131/1
Date of Issue: 2011-01-31

Date Received: 2011-01-28

Date Tested: 2011-01-28 Date Completed: 2011-01-31

Next Due Date: 2011-03-30

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for Calibration:

Description : Laser Dust Monitor

Manufacturer : Sibata
Model No. : LD-3B
Serial No. : 541146

Sensitivity (K) 1 CPM : 0.001 mg/m³
Sen. Adjustment Scale Setting : 619 CPM
Equipment No. : A-02-07

Test Conditions:

Room Temperature : 20 degree Celsius

Relative Humidity : 68%

Test Specifications & Methodology:

- 1. Instruction and Operation Manual High Volume Sampler, Andersen Samplers, Inc.
- 2. In-house method in according to the instruction manual: The Laser Dust Monitor was compared with a calibrated High Volume Sampler and the result was used to generate the Correlation Factor (CF) between the Laser Dust Monitor and High Volume Sampler.

Results:

	Correlation Factor (CF)	0.0031
--	-------------------------	--------

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE

Laboratory Manager

This report may not be reproduced except with prior written approval from WELLAB LIMITED and the results relate only to the items calibrated or tested.



WELLAB LIMITED

Rms 816, 1516 & 1701, Technology Park,
18 On Lai Street, Shatin, N.T, Hong Kong.
Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/100924/4

Date of Issue: 2009-09-24 Date Received: 2010-09-22

Date Tested: 2010-09-22

Date Completed: 2010-09-24 Next Due Date: 2011-09-23

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: 'SVANTEK' Integrating Sound Level Meter

Manufacturer

: SVANTEK

Model No.

: SVAN 955

Serial No.

: 12553

Microphone No.

: 35222

Equipment No.

: N-08-02

Test conditions:

Room Temperatre

: 22 degree Celsius

Relative Humidity

: 59%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/100924/3

Date of Issue: 2009-09-24

Date Received: 2010-09-22 Date Tested: 2010-09-22

Date Completed: 2010-09-24

Next Due Date:

2011-09-23

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: 'SVANTEK' Integrating Sound Level Meter

Manufacturer

: SVANTEK

Model No.

: SVAN 955

Serial No.

: 12563

Microphone No.

: 34377

Equipment No.

: N-08-03

Test conditions:

Room Temperatre

: 22 degree Celsius

Relative Humidity

: 59%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T. Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/110117/1

Date of Issue: 2011-01-17

Date Received: 2011-01-14 Date Tested: 2011-01-14

Date Completed: 2011-01-17

Next Due Date: 2012-01-16

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: 'SVANTEK' Integrating Sound Level Meter

Manufacturer

: SVANTEK

Model No.

: SVAN 955

Serial No.

: 14302

Microphone No.

: 17204

Equipment No.

: N-08-04

Test conditions:

Room Temperatre

: 22 degree Celsius

Relative Humidity

: 58%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT: Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/100907/1
Date of Issue: 2010-09-07
Date Received: 2010-09-06
Date Tested: 2010-09-06

Date Completed: 2010-09-07
Next Due Date: 2011-09-06

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: 'SVANTEK' Integrating Sound Level Meter

Manufacturer Model No.

: SVANTEK

Serial No.
Microphone No.

: 21455 : 43730

: SVAN 957

Equipment No.

: N-08-07

Test conditions:

Room Temperatre

: 23 degree Celsius

Relative Humidity

: 65%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



WELLAB LIMITED Rms 816, 1516 & 1701, Tech

Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.:	C/N/100305
Date of Issue:	2010-03-05
Date Received:	2010-03-04
Date Tested:	2010-03-04
Date Completed:	2010-03-05

ATTN:

Mr. Henry Leung

Page:

Next Due Date:

1 of 1

2011-03-04

Item for calibration:

Description

Manufacturer

: Acoustical Calibrator

: Brüel & Kjær

Model No.

: 4231 : 2343007

Serial No. Project No.

: C13

Equipment No.

: N-02-02

Test conditions:

Room Temperatre

: 22 degree Celsius

Relative Humidity

: 68%

Methodology:

The sound calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level Measured SPL		Tolerance
At 94 dB SPL 94.0		94.0 ± 0.2 dB

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE
Laboratory Manager



Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.:	C/N/100902-3
Date of Issue:	2010-09-02
Date Received:	2010-09-01
Date Tested:	2010-09-01
Date Completed:	2010-09-02
Next Due Date:	2011-09-01

ATTN:

Mr. Henry Leung

Item for calibration:

Description

: Acoustical Calibrator

Manufacturer

: Brüel & Kjær

Model No.

: 4231

0 1137

: 2412367

Serial No.

2412307

Equipment No.

: N-02-03

Test conditions:

Room Temperatre

: 23 degree Celsius

Relative Humidity

: 65%

Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE



Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.:	C/N/100924/2
Date of Issue:	2010-09-24
Date Received:	2010-09-22
Date Tested:	2010-09-22
Date Completed:	2010-09-24
Next Due Date:	2011-09-23

ATTN:

Mr. Henry Leung

Page:

1 of 1

Item for calibration:

Description

: Acoustical Calibrator

Manufacturer

: SVANTEK

Model No.

: SV30A

Serial No.

: 10929

Equipment No.

: N-09-01

Test conditions:

Room Temperatre

: 22 degree Celsius

Relative Humidity

: 59%

Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE
Laboratory Manager

Room 1516 & 816, Technology Park 18 On Lai Street, Shatin, N.T., Hong Kong Tel: 2898 7388 Fax: 2898 7076 Website: http://www.wellab.com.lik B-mail: wellab@wellab.com.lik

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/91109/1
Date of Issue: 2009-11-09
Date Received: 2009-11-07
Date Tested: 2009-11-07
Date Completed: 2009-11-09

ATTN:

Mr. Henry Leung

Page:

Next Due Date:

1 of 1

2010-11-08

Item for calibration:

Description

: Acoustical Calibrator

Manufacturer

: SVANTEK

Model No.

: SV30A

Serial No.

: 10965

Equipment No.

: N-09-02

Test conditions:

Room Temperatre

: 21 degree Celsius

Relative Humidity

: 55%

Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE

APPENDIX C WIND DATA

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
1-Feb-2011	0:00	1.8	NNE
1-Feb-2011	1:00	1.7	NE
1-Feb-2011	2:00	1.5	NE
1-Feb-2011	3:00	1.4	NE
1-Feb-2011	4:00	1.1	NE
1-Feb-2011	5:00	1.1	ESE
1-Feb-2011	6:00	1.0	ENE
1-Feb-2011	7:00	1.1	ENE
1-Feb-2011	8:00	1.1	ENE
1-Feb-2011	9:00	1.6	WSW
1-Feb-2011	10:00	2.0	SSW
1-Feb-2011	11:00	2.0	WSW
1-Feb-2011	12:00	2.4	SSE
1-Feb-2011	13:00	2.5	WNW
1-Feb-2011	14:00	2.4	SE
1-Feb-2011	15:00	2.7	WNW
1-Feb-2011	16:00	2.3	NNW
1-Feb-2011	17:00	2.2	WNW
1-Feb-2011	18:00	1.7	WNW
1-Feb-2011	19:00	1.5	ENE
1-Feb-2011	20:00	1.6	ENE
1-Feb-2011	21:00	2.0	ENE
1-Feb-2011	22:00	2.0	ENE
1-Feb-2011	23:00	1.8	NE NE
2-Feb-2011	0:00	1.8	ENE
2-Feb-2011	1:00	1.7	W
2-Feb-2011	2:00	1.6	WSW
2-Feb-2011	3:00	1.5	W
2-Feb-2011	4:00	1.6	WNW
2-Feb-2011	5:00	1.2	WSW
2-Feb-2011	6:00	1.2	WSW
2-Feb-2011	7:00	1.1	WNW
2-Feb-2011	8:00	1.4	WNW
2-Feb-2011	9:00	1.7	WSW
2-Feb-2011	10:00	1.9	W
2-Feb-2011	11:00	2.0	W
2-Feb-2011	12:00	2.5	W
2-Feb-2011	13:00	2.6	NNE
2-Feb-2011	14:00	2.7	NNE
2-Feb-2011	15:00	2.9	NNE
2-Feb-2011	16:00	1.8	WNW
2-Feb-2011	17:00	1.9	W
2-Feb-2011	18:00	2.0	W
2-Feb-2011	19:00	1.6	N
2-Feb-2011	20:00	1.7	NNE
2-Feb-2011	21:00	1.8	NNE
2-Feb-2011	22:00	1.7	N
2-Feb-2011	23:00	1.6	ENE
3-Feb-2011	0:00	1.7	NNE
3-Feb-2011	1:00	1.9	ESE
3-Feb-2011	2:00	1.6	ENE
3-Feb-2011	3:00	1.4	ESE
0100-2011			
3-Feb-2011	4:00	1.4	ESE

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
3-Feb-2011	6:00	0.9	WNW
3-Feb-2011	7:00	1.1	N
3-Feb-2011	8:00	1.6	SSW
3-Feb-2011	9:00	2.2	S
3-Feb-2011	10:00	2.4	WSW
3-Feb-2011	11:00	2.3	SW
3-Feb-2011	12:00	2.8	SW
3-Feb-2011	13:00	2.8	SW
3-Feb-2011	14:00	2.5	SW
3-Feb-2011	15:00	2.8	SW
3-Feb-2011	16:00	2.7	WNW
3-Feb-2011	17:00	2.6	SSW
3-Feb-2011	18:00	1.8	SW
3-Feb-2011	19:00	1.8	NE NE
3-Feb-2011	20:00	1.8	NE NE
3-Feb-2011	21:00	1.7	NE NE
3-Feb-2011	22:00	1.5	ENE
3-Feb-2011	23:00	1.9	ENE
4-Feb-2011	0:00	1.8	ENE
4-Feb-2011	1:00	1.7	E
4-Feb-2011	2:00	1.5	ENE
4-Feb-2011	3:00	1.5	SE
4-Feb-2011	4:00	1.4	SSE
4-Feb-2011	5:00	1.6	SE
4-Feb-2011	6:00	1.5	NNE
4-Feb-2011	7:00	1.3	NE
4-Feb-2011	8:00	1.4	ENE
4-Feb-2011	9:00	1.6	SSE
4-Feb-2011	10:00	2.0	SSE
4-Feb-2011	11:00	2.4	ENE
4-Feb-2011	12:00	2.6	N
4-Feb-2011	13:00	2.5	NNE
4-Feb-2011	14:00	2.4	NNE
4-Feb-2011	15:00	2.6	ESE
4-Feb-2011	16:00	2.3	ESE
4-Feb-2011	17:00	2.5	ESE
4-Feb-2011	18:00	2.0	NNE
4-Feb-2011	19:00	1.7	ENE
4-Feb-2011	20:00	2.0	SSE
4-Feb-2011	21:00	1.5	E
4-Feb-2011	22:00	1.6	NNE
4-Feb-2011	23:00	1.7	NE
5-Feb-2011	0:00	1.6	NE
5-Feb-2011	1:00	1.6	ENE
5-Feb-2011	2:00	1.8	N
5-Feb-2011	3:00	2.1	NE
5-Feb-2011	4:00	2.0	E
5-Feb-2011	5:00	1.9	NNE
5-Feb-2011	6:00	1.8	NNE
5-Feb-2011	7.00	1.9	NE
	7:00		
5-Feb-2011	8:00	2.0	NE
			NE NE
5-Feb-2011	8:00	2.0	

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
5-Feb-2011	12:00	3.0	NE
5-Feb-2011	13:00	3.4	NE
5-Feb-2011	14:00	3.5	ENE
5-Feb-2011	15:00	3.3	NNE
5-Feb-2011	16:00	3.0	ENE
5-Feb-2011	17:00	3.2	ENE
5-Feb-2011	18:00	2.8	NE
5-Feb-2011	19:00	2.6	NNE
5-Feb-2011	20:00	2.5	NNE
5-Feb-2011	21:00	2.6	ENE
5-Feb-2011	22:00	2.7	SE
5-Feb-2011	23:00	2.5	SE
6-Feb-2011	0:00	1.5	NE
6-Feb-2011	1:00	1.6	ESE
6-Feb-2011	2:00	1.3	ESE
6-Feb-2011	3:00	1.2	ENE
6-Feb-2011	4:00	1.3	ESE
6-Feb-2011	5:00	1.4	ESE
6-Feb-2011	6:00	1.4	N
6-Feb-2011	7:00	1.3	NE
6-Feb-2011	8:00	1.6	ENE
6-Feb-2011	9:00	1.8	SE
6-Feb-2011	10:00	2.2	SSE
6-Feb-2011	11:00	2.7	E
6-Feb-2011	12:00	2.4	S
6-Feb-2011	13:00	2.7	E E
6-Feb-2011	14:00	2.6	SE
6-Feb-2011	15:00	2.7	ESE
6-Feb-2011	16:00	2.2	ESE
6-Feb-2011	17:00	2.1	SE
6-Feb-2011	18:00	1.8	NE
6-Feb-2011	19:00	2.0	ENE
6-Feb-2011	20:00	2.0	SSE
6-Feb-2011	21:00	1.3	ESE
6-Feb-2011	22:00	1.1	SE
6-Feb-2011	23:00	1.1	NNE
7-Feb-2011	0:00	0.9	ESE
7-Feb-2011	1:00	0.8	SSE
7-Feb-2011	2:00	0.8	NE
7-Feb-2011	3:00	0.9	ENE
7-Feb-2011	4:00	0.7	ENE
7-Feb-2011	5:00	1.0	ENE
7-Feb-2011	6:00	1.2	NE
7-Feb-2011	7:00	0.9	ENE
7-Feb-2011	8:00	1.1	ENE
7-Feb-2011	9:00	1.5	ENE
7-Feb-2011	10:00	1.8	ESE
7-Feb-2011	11:00	2.0	ESE
7-Feb-2011	12:00	2.8	ESE
7-Feb-2011	13:00	2.5	ESE
7-Feb-2011	14:00	2.3	E E
7-Feb-2011 7-Feb-2011	15:00	2.3	ENE
7-Feb-2011 7-Feb-2011	16:00	2.1	SSE
7-Feb-2011 7-Feb-2011	17:00	2.2	E SSE
1-1 60-2011	17.00	۷.۷	L

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
7-Feb-2011	18:00	1.7	SE
7-Feb-2011	19:00	1.3	SE
7-Feb-2011	20:00	1.0	SE
7-Feb-2011	21:00	1.1	SE
7-Feb-2011	22:00	1.0	SSE
7-Feb-2011	23:00	1.0	SSE
8-Feb-2011	0:00	0.8	SSE
8-Feb-2011	1:00	0.7	SE
8-Feb-2011	2:00	0.7	SE
8-Feb-2011	3:00	0.9	SE
8-Feb-2011	4:00	0.7	SE
8-Feb-2011	5:00	0.8	ESE
8-Feb-2011	6:00	0.7	E
8-Feb-2011	7:00	0.9	<u>-</u>
8-Feb-2011	8:00	1.6	E E
8-Feb-2011	9:00	1.9	ESE
	10:00	2.1	ESE
8-Feb-2011		2.1	ESE
8-Feb-2011	11:00		
8-Feb-2011	12:00	2.1	NE
8-Feb-2011	13:00	2.0	ENE
8-Feb-2011	14:00	2.4	<u>E</u>
8-Feb-2011	15:00	2.2	E
8-Feb-2011	16:00	1.9	ENE
8-Feb-2011	17:00	2.2	N
8-Feb-2011	18:00	1.7	NE
8-Feb-2011	19:00	1.7	NE
8-Feb-2011	20:00	1.5	ENE
8-Feb-2011	21:00	1.6	ENE
8-Feb-2011	22:00	1.7	NNE
8-Feb-2011	23:00	1.7	SSE
9-Feb-2011	0:00	1.7	SSE
9-Feb-2011	1:00	1.5	ESE
9-Feb-2011	2:00	1.3	NE
9-Feb-2011	3:00	1.3	N
9-Feb-2011	4:00	1.4	NE
9-Feb-2011	5:00	1.4	E
9-Feb-2011	6:00	1.3	ENE
9-Feb-2011	7:00	1.3	NE
9-Feb-2011	8:00	1.6	ENE
9-Feb-2011	9:00	2.0	W
9-Feb-2011	10:00	2.2	SE
9-Feb-2011	11:00	2.4	SSE
9-Feb-2011	12:00	2.3	ENE
9-Feb-2011	13:00	2.0	E
9-Feb-2011	14:00	2.0	NE
9-Feb-2011	15:00	2.2	ESE
9-Feb-2011	16:00	2.3	ESE
9-Feb-2011	17:00	1.9	ESE
9-Feb-2011	18:00	1.6	ENE
9-Feb-2011	19:00	1.2	ENE
9-Feb-2011	20:00	1.0	ENE
9-Feb-2011	21:00	1.2	NNE
9-Feb-2011	22:00	1.2	ENE
9-Feb-2011	23:00	1.0	ENE
			· ·-

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
10-Feb-2011	0:00	1.0	ENE
10-Feb-2011	1:00	1.4	E
10-Feb-2011	2:00	1.4	NNE
10-Feb-2011	3:00	1.8	N
10-Feb-2011	4:00	1.7	N
10-Feb-2011	5:00	1.6	ENE
10-Feb-2011	6:00	1.0	N
10-Feb-2011	7:00	1.3	ENE
10-Feb-2011	8:00	1.7	ENE
10-Feb-2011	9:00	2.2	ENE
10-Feb-2011	10:00	3.0	ENE
10-Feb-2011	11:00	3.0	E
10-Feb-2011	12:00	3.1	<u> </u>
10-Feb-2011	13:00	3.1	ENE
10-Feb-2011	14:00	2.6	ENE
10-Feb-2011	15:00	2.2	SSW
10-Feb-2011	16:00	2.1	SSW
10-Feb-2011	17:00	2.1	ENE
10-Feb-2011	18:00	1.7	NE NE
10-Feb-2011	19:00	1.7	SW
10-Feb-2011	20:00	1.6	SSE
10-Feb-2011	21:00	1.5	E
10-Feb-2011	22:00	1.2	E E
10-Feb-2011	23:00	1.6	ENE
11-Feb-2011	0:00	1.9	ENE
11-Feb-2011	1:00	1.8	SE
11-Feb-2011	2:00	1.8	ENE
11-Feb-2011	3:00	1.2	ENE
11-Feb-2011	4:00	1.4	NE NE
11-Feb-2011	5:00	1.8	ENE
11-Feb-2011	6:00	2.0	ENE
11-Feb-2011	7:00	1.9	SE
11-Feb-2011	8:00	2.1	ESE
11-Feb-2011	9:00	2.7	ESE
11-Feb-2011	10:00	2.7	SE
11-Feb-2011	11:00	2.6	SSE
11-Feb-2011	12:00	2.9	SE
11-Feb-2011	13:00	2.9	NNE
11-Feb-2011	14:00	2.9	ENE
11-Feb-2011	15:00	2.9	ENE
11-Feb-2011	16:00	2.6	E
11-Feb-2011	17:00	2.8	ENE
11-Feb-2011	18:00	2.6	SE
11-Feb-2011	19:00	2.2	SE
11-Feb-2011	20:00	2.4	SE
11-Feb-2011	21:00	2.6	SSE
11-Feb-2011	22:00	2.2	SSE
11-Feb-2011	23:00	2.2	S
12-Feb-2011	0:00	2.3	NE
12-Feb-2011	1:00	2.3	SE
12-Feb-2011	2:00	2.1	ENE
12-Feb-2011	3:00	2.1	SSE
12-Feb-2011	4:00	2.2	ESE
12-Feb-2011	5:00	2.0	ESE
12 1 00 2011	5.00	2.0	

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
12-Feb-2011	6:00	1.7	ENE
12-Feb-2011	7:00	2.1	ENE
12-Feb-2011	8:00	2.5	ENE
12-Feb-2011	9:00	2.7	ENE
12-Feb-2011	10:00	2.7	NE
12-Feb-2011	11:00	2.8	ENE
12-Feb-2011	12:00	3.2	NE
12-Feb-2011	13:00	3.4	NNE
12-Feb-2011	14:00	3.0	ENE
12-Feb-2011	15:00	3.0	NE
12-Feb-2011	16:00	3.0	NE
12-Feb-2011	17:00	3.0	NE
12-Feb-2011	18:00	2.8	NE
12-Feb-2011	19:00	2.5	NE
12-Feb-2011	20:00	2.1	ENE
12-Feb-2011	21:00	2.0	ENE
12-Feb-2011	22:00	2.3	N
12-Feb-2011	23:00	2.4	ENE
13-Feb-2011	0:00	2.1	ENE
13-Feb-2011	1:00	2.1	SSE
13-Feb-2011	2:00	1.7	SE
13-Feb-2011	3:00	1.7	NE
13-Feb-2011	4:00	1.4	S
13-Feb-2011	5:00	1.7	NNE
13-Feb-2011	6:00	1.6	ENE
13-Feb-2011	7:00	1.6	SE
13-Feb-2011	8:00	2.0	SSE
13-Feb-2011	9:00	2.7	SE
13-Feb-2011	10:00	2.9	SE
13-Feb-2011	11:00	3.2	ENE
13-Feb-2011	12:00	3.5	NNE
13-Feb-2011	13:00	3.3	NNE
13-Feb-2011	14:00	3.1	ENE
13-Feb-2011	15:00	2.8	ESE
13-Feb-2011	16:00	2.6	ESE
13-Feb-2011	17:00	2.4	ENE
13-Feb-2011	18:00	2.2	ENE
13-Feb-2011	19:00	2.0	NE NE
13-Feb-2011	20:00	1.7	ENE
13-Feb-2011	21:00	1.7	NE
13-Feb-2011	22:00	1.2	ENE
13-Feb-2011	23:00	1.4	NE
14-Feb-2011	0:00	1.5	ENE
14-Feb-2011	1:00	1.3	NE
14-Feb-2011	2:00	1.4	ENE
14-Feb-2011	3:00	1.4	NNE
14-Feb-2011	4:00	1.3	NNE
14-Feb-2011	5:00	1.4	NNE
14-Feb-2011	6:00	1.0	NE
14-Feb-2011 14-Feb-2011	7:00	1.0	ENE
14-Feb-2011	8:00	1.6	NE NE
14-Feb-2011	9:00		NE NNE
14-Feb-2011	10:00	2.6	NNE NE
14-Feb-2011	11:00	3.0	NE

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
14-Feb-2011	12:00	3.1	NE
14-Feb-2011	13:00	3.0	ENE
14-Feb-2011	14:00	2.5	NNE
14-Feb-2011	15:00	2.7	ENE
14-Feb-2011	16:00	2.4	SSE
14-Feb-2011	17:00	2.0	SSE
14-Feb-2011	18:00	1.7	ENE
14-Feb-2011	19:00	1.9	SSE
14-Feb-2011	20:00	1.6	NE
14-Feb-2011	21:00	1.9	NNE
14-Feb-2011	22:00	1.7	NNE
14-Feb-2011	23:00	1.4	W
15-Feb-2011	0:00	1.7	W
15-Feb-2011	1:00	1.6	SE
15-Feb-2011	2:00	1.6	SE
15-Feb-2011	3:00	1.8	SSE
15-Feb-2011	4:00	1.5	NNE
15-Feb-2011	5:00	1.4	ENE
15-Feb-2011	6:00	1.4	E
15-Feb-2011	7:00	1.6	ENE
15-Feb-2011	8:00	1.7	ENE
15-Feb-2011	9:00	2.0	ENE
15-Feb-2011	10:00	2.6	ENE
15-Feb-2011	11:00	2.5	ENE
15-Feb-2011	12:00	2.6	ENE
15-Feb-2011	13:00	2.5	ENE
15-Feb-2011	14:00	2.6	NNE
15-Feb-2011	15:00	2.5	ENE
15-Feb-2011	16:00	2.6	ENE
15-Feb-2011	17:00	2.3	NNE
15-Feb-2011	18:00	1.9	NNE
15-Feb-2011	19:00	1.7	NNE
15-Feb-2011	20:00	1.5	NE
15-Feb-2011	21:00	1.3	ESE
15-Feb-2011	22:00	1.5	ESE
15-Feb-2011	23:00	1.3	SE
16-Feb-2011	0:00	1.7	SSE
16-Feb-2011	1:00	1.5	NE
16-Feb-2011	2:00	1.3	SSE
16-Feb-2011	3:00	1.3	ENE
16-Feb-2011	4:00	1.8	ESE
16-Feb-2011	5:00	1.8	SSE
16-Feb-2011	6:00	1.5	SSE
16-Feb-2011	7:00	1.7	SSE
16-Feb-2011	8:00	1.5	SSE
16-Feb-2011	9:00	2.1	NNE
16-Feb-2011	10:00	1.9	ENE
16-Feb-2011	11:00	2.1	ENE
16-Feb-2011	12:00	2.4	NNE
16-Feb-2011	13:00	2.7	N
16-Feb-2011	14:00	2.6	N
16-Feb-2011	15:00	2.8	N
16-Feb-2011	16:00	2.9	NE
16-Feb-2011	17:00	2.8	NE
10 1 05-2011	17.00	2.0	14⊏

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
16-Feb-2011	18:00	2.1	NE
16-Feb-2011	19:00	1.9	NE
16-Feb-2011	20:00	1.6	NE
16-Feb-2011	21:00	1.5	NNE
16-Feb-2011	22:00	1.3	ENE
16-Feb-2011	23:00	1.4	N
17-Feb-2011	0:00	1.3	NE
17-Feb-2011	1:00	1.3	NNE
17-Feb-2011	2:00	1.2	ESE
17-Feb-2011	3:00	1.2	NE
17-Feb-2011	4:00	1.1	NE
17-Feb-2011	5:00	1.0	ENE
17-Feb-2011	6:00	1.2	ENE
17-Feb-2011	7:00	1.2	NE
17-Feb-2011	8:00	1.8	NE
17-Feb-2011	9:00	2.0	NE
17-Feb-2011	10:00	2.6	NNE
17-Feb-2011	11:00	2.9	ENE
17-Feb-2011	12:00	2.9	N
17-Feb-2011	13:00	3.0	N
17-Feb-2011	14:00	3.2	NNW
17-Feb-2011	15:00	3.2	NNW
17-Feb-2011	16:00	2.8	W
17-Feb-2011	17:00	2.1	NNW
17-Feb-2011	18:00	1.7	NNW
17-Feb-2011	19:00	1.4	NNW
17-Feb-2011	20:00	1.3	WSW
17-Feb-2011	21:00	1.5	WSW
17-Feb-2011	22:00	1.7	SW
17-Feb-2011	23:00	1.4	W
18-Feb-2011	0:00	1.0	W
18-Feb-2011	1:00	1.1	WSW
18-Feb-2011	2:00	1.0	W
18-Feb-2011	3:00	1.3	WSW
18-Feb-2011	4:00	1.7	WSW
18-Feb-2011	5:00	1.9	ENE
18-Feb-2011	6:00	1.6	E
18-Feb-2011	7:00	1.7	ENE
18-Feb-2011	8:00	3.0	NNE
18-Feb-2011	9:00	4.1	W
18-Feb-2011	10:00	4.6	SW
18-Feb-2011	11:00	4.0	WNW
18-Feb-2011	12:00	4.2	WNW
18-Feb-2011	13:00	2.4	NNE
18-Feb-2011	14:00	2.3	NE
18-Feb-2011	15:00	2.8	NNE
18-Feb-2011	16:00	3.2	NW
18-Feb-2011	17:00	3.9	NW
18-Feb-2011	18:00	3.9	W
18-Feb-2011	19:00	4.3	ENE
18-Feb-2011	20:00	4.4	ENE
18-Feb-2011	21:00	4.3	ENE
18-Feb-2011	22:00	4.2	E
18-Feb-2011	23:00	4.3	E

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
19-Feb-2011	0:00	4.6	Е
19-Feb-2011	1:00	4.4	ENE
19-Feb-2011	2:00	4.6	NE
19-Feb-2011	3:00	4.3	E
19-Feb-2011	4:00	4.3	S
19-Feb-2011	5:00	4.5	SSW
19-Feb-2011	6:00	2.6	WNW
19-Feb-2011	7:00	2.4	N
19-Feb-2011	8:00	2.7	N
19-Feb-2011	9:00	3.1	S
19-Feb-2011	10:00	3.7	WSW
19-Feb-2011	11:00	3.4	WSW
19-Feb-2011	12:00	3.0	WSW
19-Feb-2011	13:00	2.5	ENE
19-Feb-2011	14:00	2.4	SW
19-Feb-2011	15:00	2.6	NE
19-Feb-2011	16:00	2.7	W
19-Feb-2011	17:00	2.2	S
19-Feb-2011	18:00	2.0	NE
19-Feb-2011	19:00	1.5	E
19-Feb-2011	20:00	1.3	 E
19-Feb-2011	21:00	2.0	ENE
19-Feb-2011	22:00	1.7	ENE
19-Feb-2011	23:00	1.9	NE
20-Feb-2011	0:00	1.9	NE
20-Feb-2011	1:00	1.9	S
20-Feb-2011	2:00	2.2	NE
20-Feb-2011	3:00	1.9	ENE
20-Feb-2011	4:00	1.8	ENE
20-Feb-2011	5:00	1.8	ENE
20-Feb-2011	6:00	1.8	NE
20-Feb-2011	7:00	1.8	N
20-Feb-2011	8:00	1.6	ESE
20-Feb-2011	9:00	2.2	NE
20-Feb-2011	10:00	3.0	ESE
20-Feb-2011	11:00	3.0	NE
20-Feb-2011	12:00	3.5	NNE
20-Feb-2011	13:00	3.3	SE
20-Feb-2011	14:00	2.6	S
20-Feb-2011	15:00	2.6	ESE
20-Feb-2011	16:00	2.5	N
20-Feb-2011	17:00	2.1	NNE
20-Feb-2011	18:00	1.8	NNE
20-Feb-2011	19:00	1.5	NE NE
20-Feb-2011	20:00	0.9	ENE
20-Feb-2011	21:00	1.0	ENE
20-Feb-2011	22:00	0.9	ENE
20-Feb-2011	23:00	1.1	ENE
21-Feb-2011	0:00	1.0	NNE
21-Feb-2011	1:00	1.0	NNE
21-Feb-2011	2:00	1.2	SSE
21-Feb-2011	3:00	1.2	SSE
21-Feb-2011	4:00	1.2	SSE
21-Feb-2011	5:00	1.1	SSE
21100-2011	0.00	1.1	00L

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
21-Feb-2011	6:00	0.7	SE
21-Feb-2011	7:00	0.6	SE
21-Feb-2011	8:00	0.7	SE
21-Feb-2011	9:00	1.6	SSE
21-Feb-2011	10:00	1.8	SSE
21-Feb-2011	11:00	2.1	ESE
21-Feb-2011	12:00	2.1	ESE
21-Feb-2011	13:00	2.4	ESE
21-Feb-2011	14:00	2.3	ESE
21-Feb-2011	15:00	2.5	NNE
21-Feb-2011	16:00	2.3	N
21-Feb-2011	17:00	2.2	NE
21-Feb-2011	18:00	1.5	NNE
21-Feb-2011	19:00	1.5	NE
21-Feb-2011	20:00	1.5	NE
21-Feb-2011 21-Feb-2011			NE NE
	21:00	2.4	ENE
21-Feb-2011	22:00		
21-Feb-2011	23:00	1.5	SSE
22-Feb-2011	0:00	1.5	SSE
22-Feb-2011	1:00	1.5	SSE
22-Feb-2011	2:00	1.5	ENE
22-Feb-2011	3:00	1.3	ENE
22-Feb-2011	4:00	1.5	NNE
22-Feb-2011	5:00	1.3	SSE
22-Feb-2011	6:00	1.3	NNE
22-Feb-2011	7:00	1.6	NNE
22-Feb-2011	8:00	2.0	NNE
22-Feb-2011	9:00	2.3	ENE
22-Feb-2011	10:00	2.5	NNE
22-Feb-2011	11:00	2.4	ENE
22-Feb-2011	12:00	2.7	NNE
22-Feb-2011	13:00	2.4	NNE
22-Feb-2011	14:00	2.4	NE
22-Feb-2011	15:00	2.2	NNE
22-Feb-2011	16:00	2.2	NE
22-Feb-2011	17:00	1.8	NE
22-Feb-2011	18:00	1.5	SE
22-Feb-2011	19:00	1.6	SE
22-Feb-2011	20:00	1.7	NE
22-Feb-2011	21:00	1.9	SE
22-Feb-2011	22:00	2.1	ESE
22-Feb-2011	23:00	1.8	SSE
23-Feb-2011	0:00	1.9	ESE
23-Feb-2011	1:00	1.7	ENE
23-Feb-2011	2:00	1.7	ESE
23-Feb-2011	3:00	1.5	ESE
23-Feb-2011	4:00	1.6	SE
23-Feb-2011	5:00	1.7	SSE
23-Feb-2011	6:00	1.4	SSE
23-Feb-2011	7:00	1.5	SSE
23-Feb-2011	8:00	2.1	SSE
23-Feb-2011	9:00	2.1	SSE
23-Feb-2011	10:00	2.7	SSE
23-Feb-2011	11:00	3.1	ESE
20-1 00-2011	11.00	J. 1	LUL

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
23-Feb-2011	12:00	3.3	SSE
23-Feb-2011	13:00	3.3	SSE
23-Feb-2011	14:00	3.2	SSE
23-Feb-2011	15:00	2.7	SE
23-Feb-2011	16:00	2.7	SSE
23-Feb-2011	17:00	2.9	SSE
23-Feb-2011	18:00	2.4	NNE
23-Feb-2011	19:00	2.4	ENE
		2.1	
23-Feb-2011	20:00		SSE
23-Feb-2011	21:00	2.0	SE
23-Feb-2011	22:00	1.9	N N
23-Feb-2011	23:00	1.7	NE
24-Feb-2011	0:00	1.9	ESE
24-Feb-2011	1:00	1.8	ESE
24-Feb-2011	2:00	1.9	ESE
24-Feb-2011	3:00	1.9	ESE
24-Feb-2011	4:00	2.1	ESE
24-Feb-2011	5:00	2.3	ESE
24-Feb-2011	6:00	2.1	ESE
24-Feb-2011	7:00	2.1	ESE
24-Feb-2011	8:00	2.6	ENE
24-Feb-2011	9:00	2.9	SE
24-Feb-2011	10:00	3.2	SE
24-Feb-2011	11:00	3.5	ESE
24-Feb-2011	12:00	3.6	SE
24-Feb-2011	13:00	3.8	ESE
24-Feb-2011	14:00	3.4	SE
24-Feb-2011	15:00	3.1	ESE
24-Feb-2011	16:00	3.3	SE
24-Feb-2011	17:00	3.1	SE
24-Feb-2011	18:00	2.0	SE
24-Feb-2011	19:00	1.9	SSE
24-Feb-2011	20:00	1.8	SSE
24-Feb-2011	21:00	1.5	ESE
24-Feb-2011	22:00	2.0	SE
24-Feb-2011	23:00	1.9	SSE
		1.8	SSE
25-Feb-2011	0:00	2.1	
25-Feb-2011	1:00		ESE E
25-Feb-2011	2:00	2.0	
25-Feb-2011	3:00	2.1	ESE
25-Feb-2011	4:00	1.8	ESE
25-Feb-2011	5:00	1.6	ESE
25-Feb-2011	6:00	1.6	ESE
25-Feb-2011	7:00	1.4	SSE
25-Feb-2011	8:00	1.7	SSE
25-Feb-2011	9:00	2.5	SSE
25-Feb-2011	10:00	2.9	SE
25-Feb-2011	11:00	2.8	ESE
25-Feb-2011	12:00	2.6	S
25-Feb-2011	13:00	2.7	SE
25-Feb-2011	14:00	2.7	SSE
25-Feb-2011	15:00	2.9	SE
25-Feb-2011	16:00	2.4	SE
25-Feb-2011	17:00	1.9	SSE
	•	•	

Appendix C - Wind Data (Eastern Portal)

Date	Time	Wind Speed m/s	Direction
25-Feb-2011	18:00	1.4	SSE
25-Feb-2011	19:00	1.3	ESE
25-Feb-2011	20:00	1.2	ENE
25-Feb-2011	21:00	1.1	SE
25-Feb-2011	22:00	1.5	SSE
25-Feb-2011	23:00	1.5	SE
26-Feb-2011	0:00	1.5	SE
26-Feb-2011	1:00	1.2	SSE
26-Feb-2011	2:00	1.1	SSE
26-Feb-2011	3:00	1.2	SSE
26-Feb-2011	4:00	1.1	ENE
26-Feb-2011	5:00	0.9	SSE
26-Feb-2011	6:00	0.7	SSE
26-Feb-2011	7:00	0.8	SE
26-Feb-2011	8:00	1.4	NNE
26-Feb-2011	9:00	2.2	NE
26-Feb-2011	10:00	2.4	ESE
26-Feb-2011	11:00	2.2	ESE
26-Feb-2011	12:00	2.9	ESE
26-Feb-2011	13:00	3.3	SE
26-Feb-2011	14:00	3.1	SE
26-Feb-2011	15:00	2.7	SSE
26-Feb-2011	16:00	2.4	SSE
26-Feb-2011	17:00	2.0	ESE
26-Feb-2011	18:00	1.4	ENE
26-Feb-2011	19:00	1.1	ENE
26-Feb-2011	20:00	1.0	SSE
26-Feb-2011	21:00	1.2	SE
26-Feb-2011	22:00	1.1	SSE
26-Feb-2011	23:00	1.1	SSE
27-Feb-2011	0:00	1.0	E
27-Feb-2011 27-Feb-2011			SW
	1:00 2:00	0.9	ENE
27-Feb-2011		1.0	
27-Feb-2011	3:00	1.4	ENE
27-Feb-2011	4:00	1.2	ENE
27-Feb-2011	5:00	1.2	ESE
27-Feb-2011	6:00	1.1	SSE
27-Feb-2011	7:00	1.1	SE
27-Feb-2011	8:00	1.5	SSE
27-Feb-2011	9:00	2.5	ESE
27-Feb-2011	10:00	2.6	ESE
27-Feb-2011	11:00	3.1	ESE
27-Feb-2011	12:00	3.1	SSE
27-Feb-2011	13:00	3.0	SSE
27-Feb-2011	14:00	3.0	SE
27-Feb-2011	15:00	2.6	SE
27-Feb-2011	16:00	2.7	SE
27-Feb-2011	17:00	2.4	S
27-Feb-2011	18:00	1.9	ESE
27-Feb-2011	19:00	1.6	ESE
27-Feb-2011	20:00	1.9	SSE
27-Feb-2011	21:00	1.7	ENE
27-Feb-2011	22:00	1.2	ENE
27-Feb-2011	23:00	1.3	NE
41-1 CD-4011	23.00	1.3	INL

Date	Time	Wind Speed m/s	Direction
28-Feb-2011	0:00	1.3	ENE
28-Feb-2011	1:00	1.4	ESE
28-Feb-2011	2:00	1.4	ESE
28-Feb-2011	3:00	1.2	ESE
28-Feb-2011	4:00	1.1	SSE
28-Feb-2011	5:00	1.0	ESE
28-Feb-2011	6:00	1.0	ESE
28-Feb-2011	7:00	1.0	ESE
28-Feb-2011	8:00	1.3	ESE
28-Feb-2011	9:00	2.0	ESE
28-Feb-2011	10:00	2.6	ESE
28-Feb-2011	11:00	2.8	SE
28-Feb-2011	12:00	2.5	S
28-Feb-2011	13:00	2.7	ESE
28-Feb-2011	14:00	2.6	SSE
28-Feb-2011	15:00	2.7	S
28-Feb-2011	16:00	2.7	ESE
28-Feb-2011	17:00	2.4	NE
28-Feb-2011	18:00	1.8	ENE
28-Feb-2011	19:00	1.4	ENE
28-Feb-2011	20:00	1.1	ENE
28-Feb-2011	21:00	1.3	ENE
28-Feb-2011	22:00	1.2	SSE
28-Feb-2011	23:00	1.4	NE

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
1-Feb-2011	0:00	2.2	NW
1-Feb-2011	1:00	2.1	W
1-Feb-2011	2:00	1.9	N
1-Feb-2011	3:00	1.9	N
1-Feb-2011	4:00	1.8	NE
1-Feb-2011	5:00	1.8	E
1-Feb-2011	6:00	1.7	ENE
1-Feb-2011	7:00	1.8	ENE
1-Feb-2011	8:00	1.7	NE
1-Feb-2011	9:00	1.9	NE
1-Feb-2011	10:00	2.4	WNW
1-Feb-2011	11:00	2.8	ENE
1-Feb-2011	12:00	3.0	WSW
1-Feb-2011	13:00	2.9	SSE
1-Feb-2011	14:00	3.0	NNE
1-Feb-2011	15:00	3.0	NE
1-Feb-2011	16:00	2.9	W
1-Feb-2011	17:00	2.8	W
1-Feb-2011	18:00	2.4	W
1-Feb-2011	19:00	2.3	ENE
1-Feb-2011	20:00	2.3	ENE
1-Feb-2011	21:00	2.4	E
1-Feb-2011	22:00	2.4	SW
1-Feb-2011	23:00	2.4	NNE
2-Feb-2011	0:00	2.3	NNE
2-Feb-2011	1:00	2.4	W
2-Feb-2011	2:00	2.5	W
2-Feb-2011	3:00	2.2	ENE
2-Feb-2011	4:00	2.4	ENE
2-Feb-2011	5:00	2.2	ENE
2-Feb-2011	6:00	2.4	NE NE
2-Feb-2011	7:00	2.3	WNW
2-Feb-2011	8:00	2.0	W
2-Feb-2011	9:00	2.3	NE NE
2-Feb-2011	10:00	2.7	SE
2-Feb-2011	11:00	3.2	SE
2-Feb-2011	12:00	3.6	SE
2-Feb-2011	13:00	3.6	SE
2-Feb-2011	14:00	3.0	SE
2-Feb-2011	15:00	3.0	SSE
2-Feb-2011	16:00	2.5	ESE
2-Feb-2011	17:00	2.5	SSE
2-Feb-2011	18:00	2.5	NNE
2-Feb-2011	19:00	2.0	NE
2-Feb-2011	20:00	1.9	SE
2-Feb-2011	21:00	2.2	ESE
2-Feb-2011	22:00	2.3	SSE
2-Feb-2011	23:00	2.4	E E
3-Feb-2011	0:00	2.4	ENE
			NNE
3-Feb-2011	1:00	2.1	
3-Feb-2011	2:00	1.9	NNE
3-Feb-2011	3:00	2.1	NNE
3-Feb-2011	4:00 5:00	2.0	ENE
3-Feb-2011	5:00	1.9	SSE

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
3-Feb-2011	6:00	1.7	ENE
3-Feb-2011	7:00	1.9	NNE
3-Feb-2011	8:00	1.5	SSE
3-Feb-2011	9:00	1.5	ESE
3-Feb-2011	10:00	1.7	ESE
3-Feb-2011	11:00	1.4	WSW
		1.8	NE
3-Feb-2011	12:00		
3-Feb-2011	13:00	2.0	WSW
3-Feb-2011	14:00	1.9	SSW
3-Feb-2011	15:00	2.1	WSW
3-Feb-2011	16:00	1.9	W
3-Feb-2011	17:00	2.3	W
3-Feb-2011	18:00	2.2	SSW
3-Feb-2011	19:00	2.5	WSW
3-Feb-2011	20:00	2.0	ENE
3-Feb-2011	21:00	2.0	E
3-Feb-2011	22:00	1.9	ENE
3-Feb-2011	23:00	2.0	NE
4-Feb-2011	0:00	2.6	NE
4-Feb-2011	1:00	2.3	NE
4-Feb-2011	2:00	2.0	ENE
4-Feb-2011	3:00	2.0	NNE
4-Feb-2011	4:00	1.7	SE
4-Feb-2011	5:00	1.5	SE
4-Feb-2011	6:00	1.8	SE
4-Feb-2011	7:00	1.7	SE
4-Feb-2011	8:00	2.3	ENE
4-Feb-2011	9:00	2.2	WSW
4-Feb-2011	10:00	2.3	WNW
4-Feb-2011	11:00	2.8	SSE
4-Feb-2011	12:00	3.1	W
		2.8	SSE
4-Feb-2011	13:00		
4-Feb-2011	14:00	2.5	NE FOE
4-Feb-2011	15:00	2.7	ESE
4-Feb-2011	16:00	1.8	ESE
4-Feb-2011	17:00	1.6	SSE
4-Feb-2011	18:00	1.1	ESE
4-Feb-2011	19:00	1.0	SE
4-Feb-2011	20:00	1.1	SW
4-Feb-2011	21:00	1.5	SW
4-Feb-2011	22:00	1.7	NE
4-Feb-2011	23:00	1.6	SW
5-Feb-2011	0:00	1.7	WSW
5-Feb-2011	1:00	2.0	ESE
5-Feb-2011	2:00	2.1	SSW
5-Feb-2011	3:00	1.9	W
5-Feb-2011	4:00	2.2	W
5-Feb-2011	5:00	2.4	W
5-Feb-2011	6:00	2.1	WNW
5-Feb-2011	7:00	2.4	SW
5-Feb-2011	8:00	2.5	N
5-Feb-2011	9:00	2.7	SSE
5-Feb-2011	10:00	3.1	SSW
5-Feb-2011	11:00	2.9	ENE
ე- <u></u>	11.00	۷.۶	EINE

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
5-Feb-2011	12:00	3.1	E
5-Feb-2011	13:00	3.7	N
5-Feb-2011	14:00	3.5	SW
5-Feb-2011	15:00	3.3	NNE
5-Feb-2011	16:00	2.7	N
5-Feb-2011	17:00	2.3	SW
5-Feb-2011	18:00	2.2	S
5-Feb-2011	19:00	2.2	SSE
5-Feb-2011	20:00	2.3	SE
5-Feb-2011	21:00	2.3	S
5-Feb-2011	22:00	2.1	ENE
5-Feb-2011	23:00	2.0	SSW
6-Feb-2011	0:00	1.9	SSW
6-Feb-2011	1:00	2.2	ESE
6-Feb-2011	2:00	2.0	NNE
6-Feb-2011	3:00	2.2	E
6-Feb-2011	4:00	2.6	 N
6-Feb-2011	5:00	2.7	N
6-Feb-2011	6:00	2.4	ENE
6-Feb-2011	7:00	2.4	ENE
6-Feb-2011	8:00	2.6	ENE
6-Feb-2011	9:00	2.7	NNE
6-Feb-2011	10:00	2.3	SSE
6-Feb-2011	11:00	2.6	SSE
6-Feb-2011	12:00	2.4	NE
6-Feb-2011	13:00	2.9	ENE
6-Feb-2011	14:00	2.6	NNE
6-Feb-2011	15:00	2.6	NNE
6-Feb-2011	16:00	2.2	NE
6-Feb-2011	17:00	2.3	NE
6-Feb-2011	18:00	2.1	ENE
6-Feb-2011	19:00	2.1	SE
6-Feb-2011	20:00	1.9	ENE
6-Feb-2011	21:00	1.2	SSE
6-Feb-2011	22:00	1.1	ENE
6-Feb-2011	23:00	1.1	NE
7-Feb-2011	0:00	1.0	ENE
7-Feb-2011	1:00	1.1	NNE
7-Feb-2011	2:00	1.2	NNE
7-Feb-2011	3:00	1.4	NNE
7-Feb-2011	4:00	1.0	WSW
7-Feb-2011	5:00	1.6	ENE
7-Feb-2011	6:00	1.7	SW
7-Feb-2011	7:00	1.6	SSW
7-Feb-2011	8:00	1.9	ESE
7-Feb-2011	9:00	2.1	NNE
7-Feb-2011	10:00	2.3	NE NE
7-Feb-2011	11:00	2.1	NE
7-Feb-2011	12:00	2.5	NE
7-Feb-2011	13:00	2.3	N N
7-Feb-2011	14:00	2.3	ENE
7-Feb-2011	15:00	2.3	NE NE
7-Feb-2011	16:00	2.4	NE
7-Feb-2011	17:00	2.4	ENE

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
7-Feb-2011	18:00	2.0	E
7-Feb-2011	19:00	1.6	NE
7-Feb-2011	20:00	1.0	ESE
7-Feb-2011	21:00	1.1	NNE
7-Feb-2011	22:00	1.2	NE
7-Feb-2011	23:00	1.3	NNE
8-Feb-2011	0:00	1.2	NNE
8-Feb-2011	1:00	1.4	NE
8-Feb-2011	2:00	1.3	N
8-Feb-2011	3:00	1.3	NE
8-Feb-2011	4:00	1.1	ENE
8-Feb-2011	5:00	1.3	ENE
8-Feb-2011	6:00	1.2	ENE
8-Feb-2011	7:00	1.4	NNE
8-Feb-2011	8:00	1.7	SE
8-Feb-2011	9:00	1.9	SE
8-Feb-2011	10:00	2.0	N
8-Feb-2011	11:00	2.3	ENE
8-Feb-2011	12:00	2.4	WSW
8-Feb-2011	13:00	2.4	ESE
8-Feb-2011	14:00	2.7	ENE
8-Feb-2011	15:00	2.6	N
8-Feb-2011	16:00	2.1	ENE
8-Feb-2011	17:00	1.5	ENE
8-Feb-2011	18:00	1.4	NE NE
8-Feb-2011	19:00	1.7	N
8-Feb-2011	20:00	2.0	SSW
8-Feb-2011	21:00	2.1	SW
8-Feb-2011	22:00	1.8	SW
8-Feb-2011	23:00	1.6	SW
9-Feb-2011	0:00	1.7	ENE
9-Feb-2011	1:00	1.5	NE
9-Feb-2011	2:00	1.4	NE
9-Feb-2011	3:00	1.2	NE
9-Feb-2011	4:00	1.5	NE
9-Feb-2011	5:00	1.1	NE
9-Feb-2011	6:00	1.2	ENE
9-Feb-2011	7:00	1.3	ENE
9-Feb-2011	8:00	1.5	NNE
9-Feb-2011	9:00	2.1	NNE
9-Feb-2011	10:00	2.3	NNE
9-Feb-2011	11:00	2.6	E
9-Feb-2011	12:00	2.3	ENE
9-Feb-2011	13:00	2.1	NE
9-Feb-2011	14:00	1.8	NE
9-Feb-2011	15:00	1.9	NE
9-Feb-2011	16:00	2.0	ESE
9-Feb-2011	17:00	1.9	SSE
9-Feb-2011	18:00	1.5	NE
9-Feb-2011	19:00	1.2	NE
9-Feb-2011	20:00	2.0	NNE
9-Feb-2011	21:00	2.2	NNE
9-Feb-2011	22:00	2.2	NE NE
9-Feb-2011	23:00	2.1	SSE

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
10-Feb-2011	0:00	2.1	NNE
10-Feb-2011	1:00	1.9	SE
10-Feb-2011	2:00	1.9	N
10-Feb-2011	3:00	2.3	NNE
10-Feb-2011	4:00	2.1	NE
10-Feb-2011	5:00	1.9	ENE
10-Feb-2011	6:00	1.9	ENE
10-Feb-2011	7:00	2.0	NE NE
10-Feb-2011	8:00	2.3	NE
10-Feb-2011	9:00	2.6	ENE
10-Feb-2011	10:00	3.1	E
10-Feb-2011	11:00	2.8	SW
10-Feb-2011	12:00	2.3	S
10-Feb-2011	13:00	2.8	NE
10-Feb-2011	14:00	2.5	SW
	15:00	2.3	W
10-Feb-2011		2.2	vv
10-Feb-2011	16:00		W
10-Feb-2011	17:00	2.6	
10-Feb-2011	18:00	1.7	WSW
10-Feb-2011	19:00	1.6	SW
10-Feb-2011	20:00	1.8	SW
10-Feb-2011	21:00	1.8	SW
10-Feb-2011	22:00	2.3	SW
10-Feb-2011	23:00	1.4	WSW
11-Feb-2011	0:00	2.6	SW
11-Feb-2011	1:00	1.5	SW
11-Feb-2011	2:00	1.8	S
11-Feb-2011	3:00	1.4	WSW
11-Feb-2011	4:00	1.6	WNW
11-Feb-2011	5:00	1.9	W
11-Feb-2011	6:00	1.9	SW
11-Feb-2011	7:00	1.8	SW
11-Feb-2011	8:00	2.1	SW
11-Feb-2011	9:00	2.7	SW
11-Feb-2011	10:00	2.7	SW
11-Feb-2011	11:00	2.9	W
11-Feb-2011	12:00	3.1	WNW
11-Feb-2011	13:00	3.1	W
11-Feb-2011	14:00	3.0	W
11-Feb-2011	15:00	3.1	W
11-Feb-2011	16:00	3.0	WSW
11-Feb-2011	17:00	2.9	SW
11-Feb-2011	18:00	2.0	W
11-Feb-2011	19:00	2.0	ENE
11-Feb-2011	20:00	2.1	SW
11-Feb-2011	21:00	2.3	WSW
11-Feb-2011	22:00	2.0	SSW
11-Feb-2011	23:00	2.2	WSW
12-Feb-2011	0:00	2.0	W
12-Feb-2011	1:00	2.0	WSW
12-Feb-2011	2:00	2.2	WSW
12-Feb-2011	3:00	2.4	WSW
12-Feb-2011	4:00	2.1	SW
12-Feb-2011	5:00	2.2	W
		_	*

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
12-Feb-2011	6:00	2.2	ESE
12-Feb-2011	7:00	2.6	ESE
12-Feb-2011	8:00	2.7	NE
12-Feb-2011	9:00	2.6	NE
12-Feb-2011	10:00	2.8	W
12-Feb-2011	11:00	2.8	WSW
12-Feb-2011	12:00	3.1	WNW
12-Feb-2011	13:00	3.2	WNW
12-Feb-2011	14:00	3.2	W
12-Feb-2011	15:00	3.1	W
12-Feb-2011	16:00	2.9	W
12-Feb-2011	17:00	2.7	SSW
12-Feb-2011	18:00	2.6	NW
12-Feb-2011	19:00	2.5	NW
12-Feb-2011	20:00	2.4	NW
12-Feb-2011	21:00	2.0	W
12-Feb-2011	22:00	2.4	W
12-Feb-2011	23:00	2.6	W
13-Feb-2011	0:00	2.2	WNW
13-Feb-2011	1:00	2.3	WNW
13-Feb-2011	2:00	1.9	WNW
13-Feb-2011	3:00	1.9	W
13-Feb-2011	4:00	1.8	WSW
13-Feb-2011	5:00	1.9	W
13-Feb-2011	6:00	2.2	WSW
13-Feb-2011	7:00	1.9	W
13-Feb-2011	8:00	2.3	ESE
13-Feb-2011	9:00	2.6	NE
13-Feb-2011	10:00	3.1	NE
13-Feb-2011	11:00	3.4	ENE
13-Feb-2011	12:00	3.7	W
13-Feb-2011	13:00	3.5	SW
13-Feb-2011	14:00	3.3	SW
13-Feb-2011	15:00	3.1	N
13-Feb-2011	16:00	2.6	ENE
13-Feb-2011	17:00	2.5	SW
13-Feb-2011	18:00	2.2	SW
13-Feb-2011	19:00	2.1	WSW
13-Feb-2011	20:00	1.7	WSW
13-Feb-2011	21:00	1.5	WSW
13-Feb-2011	22:00	1.6	SW
13-Feb-2011	23:00	1.7	WSW
14-Feb-2011	0:00	1.7	WSW
14-Feb-2011	1:00	1.4	SW
14-Feb-2011	2:00	1.6	W
14-Feb-2011	3:00	1.6	WNW
14-Feb-2011	4:00	1.5	NNE
14-Feb-2011	5:00	1.4	N
14-Feb-2011	0.00	1.3	W
	6:00	1.0	
14-Feb-2011	7:00	1.5	WSW
14-Feb-2011 14-Feb-2011			
	7:00	1.5	WSW
14-Feb-2011	7:00 8:00	1.5 1.6	WSW SW

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
14-Feb-2011	12:00	3.5	E
14-Feb-2011	13:00	3.5	SW
14-Feb-2011	14:00	3.2	WSW
14-Feb-2011	15:00	3.3	WSW
14-Feb-2011	16:00	3.2	W
14-Feb-2011	17:00	3.1	WNW
		2.6	SW
14-Feb-2011	18:00		
14-Feb-2011	19:00	2.3	SW
14-Feb-2011	20:00	2.0	SE
14-Feb-2011	21:00	2.0	WSW
14-Feb-2011	22:00	2.0	WSW
14-Feb-2011	23:00	1.6	WSW
15-Feb-2011	0:00	1.6	W
15-Feb-2011	1:00	1.5	WSW
15-Feb-2011	2:00	1.4	SSW
15-Feb-2011	3:00	1.6	SW
15-Feb-2011	4:00	1.4	WSW
15-Feb-2011	5:00	1.6	W
15-Feb-2011	6:00	1.6	SE
15-Feb-2011	7:00	1.7	SE
15-Feb-2011	8:00	1.6	WSW
15-Feb-2011	9:00	1.9	WSW
15-Feb-2011	10:00	2.5	SW
15-Feb-2011	11:00	2.6	SW
15-Feb-2011	12:00	2.6	N
15-Feb-2011	13:00	2.7	ENE
15-Feb-2011	14:00	2.5	E
15-Feb-2011	15:00	3.0	NE
15-Feb-2011	16:00	2.8	W
15-Feb-2011	17:00	2.5	N
15-Feb-2011	18:00	2.5	N N
		1.9	NE
15-Feb-2011	19:00		
15-Feb-2011	20:00	1.8	N NE
15-Feb-2011	21:00	2.1	NE
15-Feb-2011	22:00	1.8	NNW
15-Feb-2011	23:00	1.8	NW
16-Feb-2011	0:00	2.3	NNE
16-Feb-2011	1:00	2.1	NNE
16-Feb-2011	2:00	2.2	NE
16-Feb-2011	3:00	1.8	ENE
16-Feb-2011	4:00	2.1	ENE
16-Feb-2011	5:00	2.4	ENE
16-Feb-2011	6:00	1.9	NE
16-Feb-2011	7:00	2.3	NE
16-Feb-2011	8:00	1.7	Е
16-Feb-2011	9:00	2.4	ENE
16-Feb-2011	10:00	2.4	SSW
16-Feb-2011	11:00	2.9	SSE
16-Feb-2011	12:00	3.5	SSE
16-Feb-2011	13:00	3.1	ESE
16-Feb-2011	14:00	3.4	SE
16-Feb-2011	15:00	3.0	S
16-Feb-2011	16:00	3.0	ESE
16-Feb-2011	17:00	3.1	S
10-1 60-2011	17.00	J. I	J

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
16-Feb-2011	18:00	2.8	S
16-Feb-2011	19:00	2.8	SW
16-Feb-2011	20:00	1.9	WSW
16-Feb-2011	21:00	2.0	NE
16-Feb-2011	22:00	1.5	ENE
16-Feb-2011	23:00	1.4	NNE
17-Feb-2011	0:00	1.8	WSW
17-Feb-2011	1:00	1.9	NNE
17-Feb-2011	2:00	1.8	ENE
17-Feb-2011	3:00	2.2	W
17-Feb-2011	4:00	1.5	ENE
17-Feb-2011	5:00	1.8	SE
17-Feb-2011	6:00	2.8	WSW
17-Feb-2011	7:00	1.7	SSW
17-Feb-2011	8:00	2.0	SSW
17-Feb-2011	9:00	2.4	W
17-Feb-2011	10:00	2.6	W
17-Feb-2011	11:00	3.4	WSW
17-Feb-2011	12:00	3.0	SW
17-Feb-2011	13:00	2.5	W
17-Feb-2011	14:00	2.5	W
17-Feb-2011	15:00	2.8	W
17-Feb-2011	16:00	3.4	WSW
17-Feb-2011	17:00	2.2	SSW
17-Feb-2011	18:00	2.1	SSW
17-Feb-2011	19:00	1.9	W
17-Feb-2011	20:00	1.5	WSW
17-Feb-2011	21:00	1.7	SSW
17-Feb-2011	22:00	2.1	WSW
17-Feb-2011	23:00	1.9	WSW
18-Feb-2011	0:00	1.9	WSW
18-Feb-2011	1:00	2.3	W
18-Feb-2011	2:00	1.7	ENE
18-Feb-2011	3:00	1.8	ENE
18-Feb-2011	4:00	1.9	N
18-Feb-2011	5:00	2.1	ENE
18-Feb-2011	6:00	1.7	ENE
18-Feb-2011	7:00	1.8	ENE
18-Feb-2011	8:00	2.6	N
18-Feb-2011	9:00	3.4	N
18-Feb-2011	10:00	3.7	ENE
18-Feb-2011	11:00	3.6	SE
18-Feb-2011	12:00	4.0	N
18-Feb-2011	13:00	3.5	N
18-Feb-2011	14:00	3.2	N
18-Feb-2011	15:00	3.6	ENE
18-Feb-2011	16:00	3.5	ENE
18-Feb-2011	17:00	3.4	NE
18-Feb-2011	18:00	3.2	NE NE
18-Feb-2011	19:00	3.2	E
18-Feb-2011	20:00	3.4	ESE
18-Feb-2011	21:00	3.1	E
18-Feb-2011	22:00	3.6	ENE
18-Feb-2011	23:00	3.2	SE
10 1 00-2011	20.00	0.2	OL.

Appendix C - Wind Data (Western Portal)

Date	Time	Wind Speed m/s	Direction
19-Feb-2011	0:00	3.6	SSE
19-Feb-2011	1:00	3.4	SSE
19-Feb-2011	2:00	3.6	E
19-Feb-2011	3:00	3.3	E
19-Feb-2011	4:00	3.2	E
19-Feb-2011	5:00	3.4	E
19-Feb-2011	6:00	2.7	SE
19-Feb-2011	7:00	2.4	ENE
19-Feb-2011	8:00	2.7	SSE
19-Feb-2011	9:00	3.4	SSE
19-Feb-2011	10:00	3.6	SSW
19-Feb-2011	11:00	3.6	E
19-Feb-2011	12:00	3.4	E
19-Feb-2011	13:00	3.2	 NE
19-Feb-2011	14:00	2.8	NE
19-Feb-2011	15:00	3.2	N
19-Feb-2011	16:00	2.8	NNE
19-Feb-2011	17:00	2.4	NE NE
19-Feb-2011	18:00	2.1	NE
19-Feb-2011	19:00	1.9	WSW
19-Feb-2011	20:00	1.9	NNE
19-Feb-2011	21:00	1.4	NNE
19-Feb-2011	22:00	2.2	E
19-Feb-2011	23:00	2.3	NNE
20-Feb-2011	0:00	2.0	NE
20-Feb-2011	1:00	2.0	ENE
20-Feb-2011	2:00	2.1	ENE
20-Feb-2011	3:00	2.4	ENE
20-Feb-2011	4:00	2.3	ENE
20-Feb-2011	5:00	2.6	ENE
20-Feb-2011	6:00	2.6	NE NE
20-Feb-2011	7:00	1.8	NE
20-Feb-2011	8:00	1.4	ENE
20-Feb-2011	9:00	2.6	NE NE
20-Feb-2011	10:00	2.5	ENE
20-Feb-2011	11:00	2.9	SSE
20-Feb-2011	12:00	2.6	SE
20-Feb-2011	13:00	3.0	SE
20-Feb-2011	14:00	2.8	SSE
20-Feb-2011	15:00	3.5	E
20-Feb-2011	16:00	3.3	SW
20-Feb-2011	17:00	3.0	SSW
20-Feb-2011	18:00	2.1	SSW
20-Feb-2011	19:00	2.0	SSW
20-Feb-2011	20:00	1.9	SW
20-Feb-2011	21:00	1.9	SW
20-Feb-2011	22:00	2.3	SW
20-Feb-2011	23:00	2.3	SSW
21-Feb-2011	0:00	2.0	WSW
21-Feb-2011	1:00	1.8	WSW
21-Feb-2011	2:00	2.0	NNE
21-Feb-2011	3:00	2.4	NNE
21-Feb-2011	4:00	2.1	SSE
21-Feb-2011	5:00	2.5	NNE
∠ 1-1 CD-ZU 1 1	J.00	۷.٠	ININL

Date	Time	Wind Speed m/s	Direction
21-Feb-2011	6:00	1.9	ENE
21-Feb-2011	7:00	1.7	E
21-Feb-2011	8:00	1.7	E
21-Feb-2011	9:00	1.7	NNE
21-Feb-2011	10:00	2.6	NNE
21-Feb-2011	11:00	2.8	ENE
21-Feb-2011	12:00	2.9	SE
21-Feb-2011	13:00	2.7	E
21-Feb-2011	14:00	2.4	<u>-</u>
21-Feb-2011	15:00	2.0	NNE
21-Feb-2011	16:00	1.9	NE
21-Feb-2011	17:00	1.9	ENE
21-Feb-2011	18:00	1.8	ENE
		2.2	
21-Feb-2011	19:00		ENE ESE
21-Feb-2011	20:00	1.5	
21-Feb-2011	21:00	2.2	ESE
21-Feb-2011	22:00	1.4	ENE
21-Feb-2011	23:00	2.0	N
22-Feb-2011	0:00	2.0	ENE
22-Feb-2011	1:00	1.4	ESE
22-Feb-2011	2:00	1.6	ESE
22-Feb-2011	3:00	2.0	ENE
22-Feb-2011	4:00	1.9	ENE
22-Feb-2011	5:00	1.4	N
22-Feb-2011	6:00	1.6	NNE
22-Feb-2011	7:00	2.0	N
22-Feb-2011	8:00	2.6	N
22-Feb-2011	9:00	2.6	NNE
22-Feb-2011	10:00	2.6	NE
22-Feb-2011	11:00	1.9	NE
22-Feb-2011	12:00	2.5	SSE
22-Feb-2011	13:00	2.2	SSE
22-Feb-2011	14:00	2.2	S
22-Feb-2011	15:00	2.1	SSE
22-Feb-2011	16:00	2.0	SSE
22-Feb-2011	17:00	1.5	SSW
22-Feb-2011	18:00	1.9	SSW
22-Feb-2011	19:00	1.8	NNW
22-Feb-2011	20:00	1.7	NNW
22-Feb-2011	21:00	2.1	NE
22-Feb-2011	22:00	1.7	NE
22-Feb-2011	23:00	1.6	N
23-Feb-2011	0:00	1.7	E
23-Feb-2011	1:00	1.7	SE
23-Feb-2011	2:00	1.7	ESE
23-Feb-2011	3:00	1.6	E
23-Feb-2011	4:00	1.9	NNW
23-Feb-2011	5:00	2.3	N
23-Feb-2011	6:00	2.5	NE
23-Feb-2011	7:00	2.3	SSW
23-Feb-2011	8:00	2.8	E
23-Feb-2011	9:00	3.1	SE
23-Feb-2011	10:00	2.9	ESE
23-Feb-2011	11:00	3.1	ESE

Date	Time	Wind Speed m/s	Direction
23-Feb-2011	12:00	3.2	SE
23-Feb-2011	13:00	3.2	SE
23-Feb-2011	14:00	3.1	SE
23-Feb-2011	15:00	2.7	NNE
23-Feb-2011	16:00	3.5	E
23-Feb-2011	17:00	3.9	NE NE
23-Feb-2011	18:00	3.5	NE
23-Feb-2011	19:00	3.4	ESE
23-Feb-2011	20:00	4.0	ESE
23-Feb-2011	21:00	4.0	ESE
23-Feb-2011	22:00	4.2	SE
23-Feb-2011	23:00	3.7	NNW
24-Feb-2011	0:00	4.0	NE
24-Feb-2011	1:00	3.7	ENE
24-Feb-2011	2:00	3.9	NE
24-Feb-2011	3:00	3.7	NE
24-Feb-2011	4:00	3.8	E
24-Feb-2011	5:00	2.8	NNE
24-Feb-2011	6:00	2.7	N
24-Feb-2011	7:00	2.7	N
24-Feb-2011	8:00	2.8	N
24-Feb-2011	9:00	3.1	W
24-Feb-2011	10:00	3.5	NNW
24-Feb-2011	11:00	3.8	N
24-Feb-2011	12:00	3.4	N
24-Feb-2011	13:00	3.6	NNW
24-Feb-2011	14:00	3.2	NNW
24-Feb-2011	15:00	3.4	N
24-Feb-2011	16:00	3.3	NNW
24-Feb-2011	17:00	3.2	WNW
24-Feb-2011	18:00	2.5	WNW
24-Feb-2011	19:00	2.1	NNW
24-Feb-2011	20:00	2.1	S
24-Feb-2011	21:00	2.1	SE
24-Feb-2011	22:00	2.6	SE
24-Feb-2011	23:00	2.6	SSE
25-Feb-2011	0:00	2.4	SE
25-Feb-2011	1:00	2.4	SE
25-Feb-2011	2:00	2.5	SE
25-Feb-2011	3:00	1.9	ESE
25-Feb-2011	4:00	2.1	ESE
25-Feb-2011 25-Feb-2011	5:00	2.1	SSW
25-Feb-2011	6:00 7:00	2.0	<u> </u>
25-Feb-2011	7:00	2.3	SSE
25-Feb-2011	8:00	2.6	
25-Feb-2011	9:00	2.9	SSW
25-Feb-2011	10:00	3.1	SSW
25-Feb-2011	11:00	3.3	<u>S</u>
25-Feb-2011	12:00	3.4	SE
25-Feb-2011	13:00	2.8	W
25-Feb-2011	14:00	2.9	SSW
25-Feb-2011	15:00	3.0	SSE
25-Feb-2011	16:00	2.9	SE
25-Feb-2011	17:00	2.6	SE

Date	Time	Wind Speed m/s	Direction
25-Feb-2011	18:00	2.1	ESE
25-Feb-2011	19:00	2.2	S
25-Feb-2011	20:00	2.1	SSE
25-Feb-2011	21:00	2.6	SE
25-Feb-2011	22:00	2.6	SE
25-Feb-2011	23:00	2.5	SSE
26-Feb-2011	0:00	2.4	SSE
26-Feb-2011	1:00	2.2	ESE
26-Feb-2011	2:00	2.4	ESE
26-Feb-2011	3:00	2.4	ENE
26-Feb-2011	4:00	1.5	E
26-Feb-2011	5:00	1.6	ESE
26-Feb-2011	6:00	1.3	NE NE
26-Feb-2011	7:00	2.0	SE
26-Feb-2011	8:00	2.1	NE
26-Feb-2011	9:00	2.4	NE
26-Feb-2011	10:00	2.8	E
26-Feb-2011	11:00	3.0	ENE
26-Feb-2011	12:00	3.2	ENE
26-Feb-2011	13:00	3.7	ESE
26-Feb-2011	14:00	3.5	ESE
26-Feb-2011	15:00	3.0	E
26-Feb-2011	16:00	3.3	WNW
26-Feb-2011	17:00	2.9	W
26-Feb-2011	18:00	2.1	N
26-Feb-2011	19:00	2.4	N
26-Feb-2011	20:00	2.3	NNE
26-Feb-2011	21:00	2.7	ENE
26-Feb-2011	22:00	2.5	NE NE
26-Feb-2011	23:00	2.6	SE
27-Feb-2011	0:00	2.5	NNW
27-Feb-2011	1:00	2.1	E
27-Feb-2011	2:00	2.3	SE
27-Feb-2011	3:00	2.1	ESE
27-Feb-2011	4:00	1.9	S
27-Feb-2011	5:00	1.8	N
27-Feb-2011	6:00	1.4	NNE
27-Feb-2011	7:00	1.7	FNF
27-Feb-2011	8:00	2.2	SE
27-Feb-2011	9:00	2.9	SE
27-Feb-2011	10:00	3.2	E
27-Feb-2011	11:00	3.3	ENE
27-Feb-2011	12:00	3.2	ESE
27-Feb-2011	13:00	2.9	NW
27-Feb-2011	14:00	3.2	ENE
27-Feb-2011	15:00	2.8	W
27-Feb-2011	16:00	2.9	SW
27-Feb-2011	17:00	3.1	E
27-Feb-2011	18:00	2.4	NE
27-Feb-2011	19:00	2.0	ESE
27-Feb-2011	20:00	2.1	NNE
27-Feb-2011	21:00	2.1	ESE
27-Feb-2011	22:00	1.8	ESE
27-Feb-2011	23:00	2.6	SSW
27 1 00 2011	20.00	2.0	5544

Date	Time	Wind Speed m/s	Direction
28-Feb-2011	0:00	2.5	E
28-Feb-2011	1:00	2.2	Е
28-Feb-2011	2:00	2.3	ESE
28-Feb-2011	3:00	2.3	SE
28-Feb-2011	4:00	2.2	SSW
28-Feb-2011	5:00	2.0	SE
28-Feb-2011	6:00	1.6	N
28-Feb-2011	7:00	1.7	ESE
28-Feb-2011	8:00	1.8	SE
28-Feb-2011	9:00	2.3	SE
28-Feb-2011	10:00	3.0	E
28-Feb-2011	11:00	3.0	E
28-Feb-2011	12:00	3.0	SSW
28-Feb-2011	13:00	3.2	SSW
28-Feb-2011	14:00	2.7	SE
28-Feb-2011	15:00	2.5	W
28-Feb-2011	16:00	2.5	WNW
28-Feb-2011	17:00	3.0	W
28-Feb-2011	18:00	2.5	NW
28-Feb-2011	19:00	1.7	N
28-Feb-2011	20:00	1.5	NNW
28-Feb-2011	21:00	2.2	W
28-Feb-2011	22:00	1.9	WNW
28-Feb-2011	23:00	2.2	W

APPENDIX D ENVIRONMENTAL MONITORING SCHEDULES

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Impact Air and Noise Monitoring Schedule for February 2011 (Eastern Portal)

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Feb	2-Feb	3-Feb	4-Feb	5-Feb
			<u>Noise</u> Daytime (07:00-19:00) ,			
			Evening time (19:00-23:00)			
			& Night-time (23:00-07:00)			
(T. I	a.r.i	24 hrs TSP	0.51	10.77.1	11.77.1	10.77.1
6-Feb	7-Feb	8-Feb	9-Feb	10-Feb	11-Feb	12-Feb
	1 hr TSP X 3	V.			1 hr TSP X 3	
Noise Daytime (07:00-19:00)		Noise Daytime (07:00-19:00), Evening time (19:00-23:00) & Night-time (23:00-07:00)				
	24 hrs TSP	,			24 hrs TSP	
13-Feb	14-Feb	15-Feb	16-Feb	17-Feb	18-Feb	19-Feb
				1 hr TSP X 3		
Noise Daytime (07:00-19:00)	Noise Daytime (07:00-19:00), Evening time (19:00-23:00) & Night-time (23:00-07:00)					
				24 hrs TSP		
20-Feb	21-Feb	22-Feb	23-Feb	24-Feb	25-Feb	26-Feb
			1 hr TSP X 3			
<u>Noise</u> Daytime (07:00-19:00)		Noise Daytime (07:00-19:00), Evening time (19:00-23:00) & Night-time (23:00-07:00)				
		& 14ight-time (25.00-07.00)	24 hrs TSP			
27-Feb	28-Feb		24 1113 131			
Noise Daytime (07:00-19:00)	20.00					

Air Quality Monitoring Station

Noise Monitoring Station

AQ1 - True Light Middle School of HK

NC1 - True Light Middle School of HK NC2 - The Legend

NC1a - Outside True Light Middle School of HK

(for restricted hours)

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Impact Air and Noise Monitoring Schedule for February 2011 (Western Portal)

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Feb	2-Feb	3-Feb	4-Feb	5-Feb
			Noise Noise			
			Daytime (07:00-19:00), Evening time (19:00-23:00) & Night-time (23:00-07:00)			
		24 hrs TSP				
6-Feb	7-Feb	8-Feb	9-Feb	10-Feb	11-Feb	12-Feb
	1 hr TSP X 3	Noise			1 hr TSP X 3	
Noise Daytime (07:00-19:00)		Daytime (07:00-19:00) , Evening time (19:00-23:00) & Night-time (23:00-07:00)				
	24 hrs TSP				24 hrs TSP	
13-Feb	14-Feb	15-Feb	16-Feb	17-Feb	18-Feb	19-Feb
	Noise			1 hr TSP X 3		
Noise Daytime (07:00-19:00)	Daytime (07:00-19:00), Evening time (19:00-23:00) & Night-time (23:00-07:00)					
***				24 hrs TSP		
20-Feb	21-Feb	22-Feb	23-Feb	24-Feb	25-Feb	26-Feb
		N.	1 hr TSP X 3			
Noise Daytime (07:00-19:00)		Noise Daytime (07:00-19:00) , Evening time (19:00-23:00)				
		& Night-time (23:00-07:00)	24 b TCD			
27-Feb	28-Feb		24 hrs TSP			
27-100	25-160					
Noise Daytime (07:00-19:00)						

Air Quality Monitoring Station

Noise Monitoring Station

AQ2 - Outside Aegean Terrace (1 hour TSP)

NC3 - Outside Aegean Terrace

AQ3 - Outside Site Office at Western Portal (24 hours TSP)

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Impact Noise Monitoring Schedule for February 2011 (Intake BR6, DG1, E5A, E7, MA14, PFLR1, PR1, THR2, W0, W5, W8 and P5)

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
Ţ.	j	1-Feb	2-Feb	3-Feb	4-Feb	5-Feb
			<u>Noise</u> Daytime (07:00-19:00)			
6-Feb	7-Feb	8-Feb	9-Feb	10-Feb	11-Feb	12-Feb
		<u>Noise</u> Daytime (07:00-19:00)				
13-Feb	14-Feb	15-Feb	16-Feb	17-Feb	18-Feb	19-Feb
	<u>Noise</u> Daytime (07:00-19:00)					
20-Feb	21-Feb	22-Feb	23-Feb	24-Feb	25-Feb	26-Feb
		<u>Noise</u> Daytime (07:00-19:00)				
27-Feb	28-Feb					

Noise Monitoring Station

Intake BR6 - Man Yuen Garden (NC4)

Intake DG 1 - Blk D Villa Monte Rosa (NC5) and Rosaryhill School (NC6)

Intake E5A - Buddist Li Ka Shing Care & Attention Home for the Elderly (NC7)

Intake E7 - Marymount Secondary School (NC8) and 117 Blue Pool Road (NC9)

Intake MA14 - The Harbour View (NC10)

Intake PFLR1 - Honey Court (NC11)

Intake RR1 - Ying Wa Girl's School (NC12) and Peaksville Court (NC13)

Intake THR2 - Hong Kong Japanese School (NC14)

Intake W0 - Hong Kong Academy (NC15)

Intake W5 - Raimondi College (NC16)

Intake W8 - Hong Kong Institute of Technology (NC17) and Blk A, 80 Robinson Road (NC18)

Intake P5 - Villa Veneto (NC19)

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Impact Ground Borne Constructon Noise Schedule for February 2011

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	-	1-Feb	2-Feb	3-Feb	4-Feb	5-Feb
			<u>Noise</u> Daytime (07:00-19:00)			
6-Feb	7-Feb	8-Feb	9-Feb	10-Feb	11-Feb	12-Feb
		<u>Noise</u> Daytime (07:00-19:00)				
13-Feb	14-Feb	15-Feb	16-Feb	17-Feb	18-Feb	19-Feb
	<u>Noise</u> Daytime (07:00-19:00)					
20-Feb	21-Feb	22-Feb	23-Feb	24-Feb	25-Feb	26-Feb
		<u>Noise</u> Daytime (07:00-19:00)				
27-Feb	28-Feb					

Noise Monitoring Station

GNC7 - Hong Villa

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Tentative Impact Air and Noise Monitoring Schedule for March 2011 (Eastern Portal)

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Mar	2-Mar	3-Mar	4-Mar	5-Mar
		1.1 TOD 3/ 2				
		1 hr TSP X 3	Noise			
			Daytime (07:00-19:00),			
			Evening time (19:00-23:00)			
			& Night-time (23:00-07:00)			
		24 hrs TSP				
6-Mar	7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar
	1 hr TSP X 3				1 hr TSP X 3	
	TIN TOT A S	Noise			THI TOT A S	
<u>Noise</u>		Daytime (07:00-19:00),				
Daytime (07:00-19:00)		Evening time (19:00-23:00)				
	*** man	& Night-time (23:00-07:00)				244 550
13-Mar	24 hrs TSP 14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	24 hrs TSP 19-Mar
15-Mar	14-1/141	13-Mai	10-1/141	1 / -IVIai	10-14141	19-Mai
				1 hr TSP X 3		
		<u>Noise</u>				
<u>Noise</u>		Daytime (07:00-19:00),				
Daytime (07:00-19:00)		Evening time (19:00-23:00) & Night-time (23:00-07:00)				
		& Night-time (23.00-07.00)			24 hrs TSP	
20-Mar	21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar
			1 hr TSP X 3			
		Noise				
<u>Noise</u> Daytime (07:00-19:00)		Daytime (07:00-19:00), Evening time (19:00-23:00)				
Daytime (07.00-19.00)		& Night-time (23:00-07:00)				
		()		24 hrs TSP		
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar		
		1 hr TSP X 3				
<u>Noise</u>				<u>Noise</u> Daytime (07:00-19:00),		
Daytime (07:00-19:00)				Evening time (19:00-23:00)		
3 (& Night-time (23:00-07:00)		
		(1 (1 (1)	24 hrs TSP			

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

Air Quality Monitoring Station

Noise Monitoring Station

AQ1 - True Light Middle School of HK

NC1 - True Light Middle School of HK

NC2 - The Legend

NC1a - Outside True Light Middle School of HK

(for restricted hours)

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Tentative Impact Air and Noise Monitoring Schedule for March 2011 (Western Portal)

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Mar	2-Mar	3-Mar	4-Mar	5-Mar
		4.1 map v. a				
		1 hr TSP X 3				
			<u>Noise</u> Daytime (07:00-19:00),			
			Evening time (19:00-23:00)			
			& Night-time (23:00-07:00)			
		24 hrs TSP				
6-Mar	7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar
	1 hr TSP X 3				1 hr TSP X 3	
Noise		Noise Daytime (07:00-19:00),				
Daytime (07:00-19:00)		Evening time (19:00-23:00)				
.,		& Night-time (23:00-07:00)				
	24 hrs TSP					24 hrs TSP
13-Mar	14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar
				11 mon v 2		
		NT. T.		1 hr TSP X 3		
<u>Noise</u>		<u>Noise</u> Daytime (07:00-19:00) ,				
Daytime (07:00-19:00)		Evening time (19:00-23:00)				
		& Night-time (23:00-07:00)				
					24 hrs TSP	
20-Mar	21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar
			1 hr TSP X 3			
		Noise	1 nr 15P X 3			
<u>Noise</u>		Daytime (07:00-19:00),				
Daytime (07:00-19:00)		Evening time (19:00-23:00)				
		& Night-time (23:00-07:00)				
				24 hrs TSP		
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar		
		1 hr TSP X 3				
		1 III 131 A 3		Noise		
<u>Noise</u>				Daytime (07:00-19:00),		
Daytime (07:00-19:00)				Evening time (19:00-23:00)		
				& Night-time (23:00-07:00)		
			24 hrs TSP			

Air Quality Monitoring Station

Noise Monitoring Station

AQ2 - Outside Aegean Terrace (1 hour TSP)

NC3 - Outside Aegean Terrace

AQ3 - Outside Site Office at Western Portal (24 hours TSP)

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Tentative Impact Noise Monitoring Schedule for March 2011 (Intake BR6, DG1, E5A, E7, MA14, PFLR1, PR1, THR2, W0, W5, W8 and P5)

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Mar	2-Mar	3-Mar	4-Mar	5-Mar
			<u>Noise</u> Daytime (07:00-19:00)			
6-Mar	7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar
		<u>Noise</u> Daytime (07:00-19:00)				
13-Mar	14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar
		<u>Noise</u> Daytime (07:00-19:00)				
20-Mar	21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar
		<u>Noise</u> Daytime (07:00-19:00)				
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar		
				<u>Noise</u> Daytime (07:00-19:00)		

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

Noise Monitoring Station

Intake BR6 - Man Yuen Garden (NC4)

Intake DG 1 - Blk D Villa Monte Rosa (NC5) and Rosaryhill School (NC6)

Intake E5A - Buddist Li Ka Shing Care & Attention Home for the Elderly (NC7)

Intake E7 - Marymount Secondary School (NC8) and 117 Blue Pool Road (NC9)

Intake MA14 - The Harbour View (NC10)

Intake PFLR1 - Honey Court (NC11)

Intake RR1 - Ying Wa Girl's School (NC12) and Peaksville Court (NC13)

Intake THR2 - Hong Kong Japanese School (NC14)

Intake W0 - Hong Kong Academy (NC15)

Intake W5 - Raimondi College (NC16)

Intake W8 - Hong Kong Institute of Technology (NC17) and Blk A, 80 Robinson Road (NC18)

Intake P5 - Villa Veneto (NC19)

Drainage Improvement in Northern Hong Kong Island - Hong Kong West Drainage Tunnel Tentative Impact Ground Borne Constructon Noise Schedule for March 2011

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	j	1-Mar	2-Mar	3-Mar	4-Mar	5-Mar
			<u>Noise</u> Daytime (07:00-19:00)			
6-Mar	7-Mar	8-Mar	9-Mar	10-Mar	11-Mar	12-Mar
		<u>Noise</u> Daytime (07:00-19:00)				
13-Mar	14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar
		<u>Noise</u> Daytime (07:00-19:00)				
20-Mar	21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar
		<u>Noise</u> Daytime (07:00-19:00)				
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar		
				<u>Noise</u> Daytime (07:00-19:00)		

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

Noise Monitoring Station

GNC7 - Hong Villa

APPENDIX E 1-HOUR TSP MONITORING RESULTS AND GRAPHICAL PRESENTATION

Appendix E - 1-hour TSP Monitoring Results

Station AQ1 (True Light Middle School of Hong Kong)

Date	Sampling	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	e (m³/min.)	Av. flow	Total vol.	Conc.
Date	Time	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	(µg/m ³)
7-Feb-11	9:00	Sunny	291.9	764.0	3.1409	3.1480	0.0071	5905.3	5906.3	1.0	1.18	1.18	1.18	71.0	100.0
7-Feb-11	10:00	Sunny	292.1	763.8	3.1514	3.1548	0.0034	5906.3	5907.3	1.0	1.18	1.18	1.18	70.9	47.9
7-Feb-11	11:00	Sunny	292.2	763.6	3.1702	3.1723	0.0021	5907.3	5908.3	1.0	1.18	1.18	1.18	70.9	29.6
11-Feb-11	9:00	Sunny	289.3	766.2	3.1698	3.1767	0.0069	5932.3	5933.3	1.0	1.19	1.19	1.19	71.4	96.7
11-Feb-11	10:00	Sunny	289.5	766.1	3.1449	3.1513	0.0064	5933.3	5934.3	1.0	1.19	1.19	1.19	71.3	89.7
11-Feb-11	11:00	Sunny	289.7	765.9	3.1395	3.1460	0.0065	5934.3	5935.3	1.0	1.19	1.19	1.19	71.3	91.2
17-Feb-11	9:00	Cloudy	288.3	765.7	3.1162	3.1307	0.0145	5959.3	5960.3	1.0	1.19	1.19	1.19	71.5	202.9
17-Feb-11	10:00	Cloudy	288.5	765.5	3.1580	3.1726	0.0146	5960.3	5961.3	1.0	1.19	1.19	1.19	71.4	204.4
17-Feb-11	11:00	Cloudy	288.7	765.3	3.1697	3.1869	0.0172	5961.3	5962.3	1.0	1.19	1.19	1.19	71.4	240.9
23-Feb-11	9:00	Cloudy	289.3	767.7	3.1856	3.1920	0.0064	5986.3	5987.3	1.0	1.19	1.19	1.19	71.4	89.6
23-Feb-11	10:00	Cloudy	289.3	767.7	3.1661	3.1684	0.0023	5987.3	5988.3	1.0	1.19	1.19	1.19	71.4	32.2
23-Feb-11	11:00	Cloudy	289.3	767.7	3.1631	3.1672	0.0041	5988.3	5989.3	1.0	1.19	1.19	1.19	71.4	57.4
														Min	29.6
														Max	240.9
														Average	106.9


MA8001/App E - 1hr TSP Cinotech


Appendix E - 1-hour TSP Monitoring Results

Station AQ2 (Out	side Aegean	Terrace)	
Date	Time	Weather	Particulate Concentration (μg/m³)
7-Feb-11	13:00	Sunny	181.7
7-Feb-11	14:00	Sunny	182.0
7-Feb-11	15:00	Sunny	181.2
11-Feb-11	13:00	Sunny	206.5
11-Feb-11	14:00	Sunny	205.9
11-Feb-11	15:00	Sunny	206.1
17-Feb-11	13:05	Cloudy	239.3
17-Feb-11	14:05	Cloudy	238.7
17-Feb-11	15:05	Cloudy	239.8
23-Feb-11	13:00	Cloudy	98.1
23-Feb-11	14:00	Cloudy	98.2
23-Feb-11	15:00	Cloudy	97.7
		Average	181.3
		Maximum	239.8
		Minimum	97.7

MA8001/App E - 1hr TSP Cinotech

1-hr TSP Concentration Levels

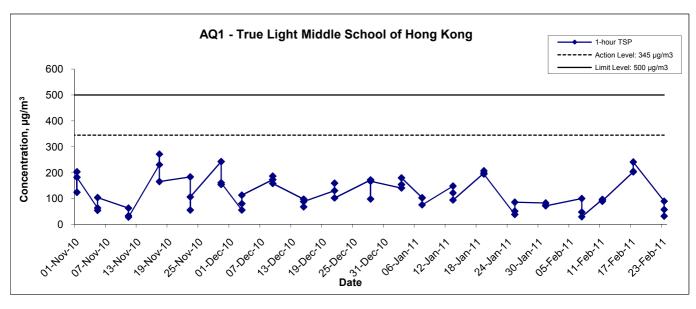

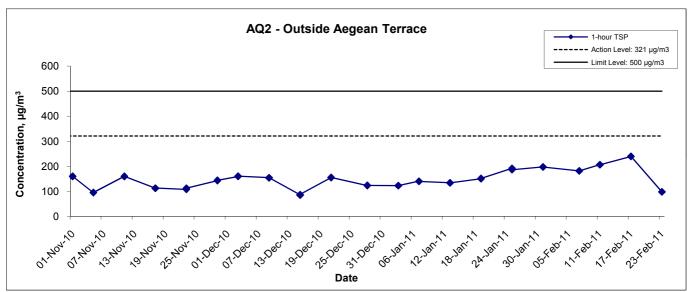

Title	Contract No. DC/2007/10	S
	Design and Construction of Hong Kong West Drainage Tunnel	
	Graphical Presentation of 1-hour TSP Monitoring Results	D

Scale		Project	
	N.T.S	No.	MA800
Date		Appendi	X
	Feb 11		Е



APPENDIX F 24-HOUR TSP MONITORING RESULTS AND GRAPHICAL PRESENTATION

Appendix F - 24-hour TSP Monitoring Results

Station AQ1 - True Light Middle School of Hong Kong


Start Date	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	(m³/min.)	Av. flow	Total vol.	Conc.
Start Date	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	$(\mu g/m^3)$
1-Feb-11	Sunny	285.6	771.6	3.1581	3.3927	0.2346	5881.3	5905.3	24.0	1.20	1.20	1.20	1728.2	135.7
7-Feb-11	Sunny	294.3	760.6	3.1993	3.3710	0.1717	5908.3	5932.3	24.0	1.18	1.18	1.18	1693.5	101.4
11-Feb-11	Cloudy	289.4	765.4	3.1316	3.2602	0.1286	5935.3	5959.3	24.0	1.19	1.19	1.19	1711.5	75.1
17-Feb-11	Sunny	289.5	763.6	3.2030	3.3091	0.1061	5962.3	5986.3	24.0	1.19	1.19	1.19	1709.4	62.1
23-Feb-11	Cloudy	289.5	767.7	3.1794	3.2823	0.1029	5989.3	6013.3	24.0	1.19	1.19	1.19	1713.6	60.0
													Min	60.0
													Max	135.7
													Average	86.9


Station AQ3 - Outside Site Office (Western Portal)

Start Date	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elaps	e Time	Sampling	Flow Rate	e (m³/min.)	Av. flow	Total vol.	Conc.
Start Date	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	$(\mu g/m^3)$
1-Feb-11	Sunny	285.6	771.6	3.1771	3.3614	0.1843	9779.1	9803.1	24.0	1.22	1.22	1.22	1753.9	105.1
7-Feb-11	Sunny	292.1	763.9	3.2401	3.4113	0.1712	9803.1	9827.1	24.0	1.20	1.20	1.20	1728.0	99.1
11-Feb-11	Sunny	289.3	766.2	3.1818	3.3660	0.1842	9827.1	9851.1	24.0	1.21	1.21	1.21	1738.0	106.0
17-Feb-11	Cloudy	288.5	765.7	3.1552	3.3851	0.2299	9851.1	9875.1	24.0	1.21	1.21	1.21	1739.9	132.1
23-Feb-11	Cloudy	289.3	767.7	3.1511	3.3052	0.1541	9875.1	9899.1	24.0	1.21	1.21	1.21	1739.6	88.6
													Min	88.6
													Max	132.1
													Average	106.2

MA8001/App F - 24hr TSP

24-hr TSP Concentration Levels

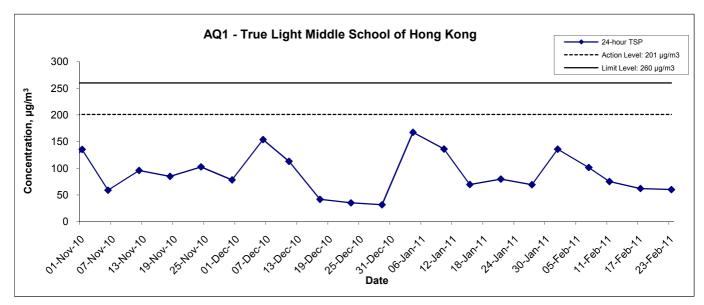

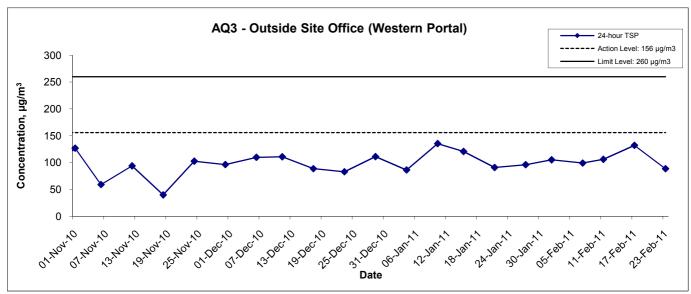

Title	Contract No. DC/2007/10
	Design and Construction of Hong Kong West Drainage Tunnel
	Graphical Presentation of 21-hour TSP Monitoring Results

Scale		Floject	
	N.T.S	No.	MA800
Date		Append	ix _
	Feb 11		F



APPENDIX G NOISE MONITORING RESULTS AND GRAPHICAL PRESENTATION

Location NC1	- True Light	Middle Scho	ol of Hong K	ong						
				Unit: dB (A) (30-min)						
Date	Date Time Weather		Mea	sured Noise I	_evel	Baseline Level	Construction Noise Level			
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}			
2-Feb-11	15:45	Sunny	68.2	70.8	64.4		68.2 Measured ≤ Baseline			
8-Feb-11	13:00	Sunny	60.9	63.1	56.7	70.2	60.9 Measured ≤ Baseline			
14-Feb-11	13:00	Cloudy	71.3	69.3	62.1	70.2	64.8			
22-Feb-11	13:00	Sunny	71.3	74.5	64.2		68.1			

Location NC2	Location NC2 - The Legend											
				Unit: dB (A) (30-min)								
Date	Date Time Weather		Mea	sured Noise I	_evel	Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	16:30	Sunny	65.3	67.7	61.1		55.7					
8-Feb-11	13:35	Sunny	61.8	63.7	59.5	64.8	61.8 Measured ≤ Baseline					
14-Feb-11	13:40	Cloudy	65.4	67.2	62.2	04.0	56.5					
22-Feb-11	13:40	Sunny	72.4	75.3	64.0		71.6					

Location NC3 - Outside Aegean Terrace											
				Unit: dB (A) (30-min)							
Date	Time	Weather	Measured Noise Level			Baseline Level	Construction Noise Level				
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}				
2-Feb-11	8:20	Cloudy	53.7	55.7	50.2		53.7 Measured ≤ Baseline				
8-Feb-11	17:40	Cloudy	52.3	54.3	49.7	57.7	52.3 Measured ≤ Baseline				
14-Feb-11	8:20	Cloudy	53.0	54.9	50.0	57.7	53.0 Measured ≤ Baseline				
22-Feb-11	8:20	Cloudy	53.7	55.5	49.7		53.7 Measured ≤ Baseline				

Location NC4	Location NC4 - Man Yuen Garden												
					Unit:	dB (A) (30-min)							
Date	Time	Weather	Measured Noise Level		Baseline Level	Construction Noise Level							
			L eq	L ₁₀	L 90	L _{eq}	L _{eq}						
2-Feb-11	13:00	Sunny	70.9	73.7	65.6		69.8						
8-Feb-11	8:20	Cloudy	66.7	69.3	63.4	64.5	62.7						
14-Feb-11	13:00	Cloudy	69.0	71.4	64.2	04.5	67.1						
22-Feb-11	13:00	Cloudy	68.9	71.8	64.0		66.9						

Location NC5	Location NC5 - Blk D Villa Monte Rosa											
				Unit: dB (A) (30-min)								
Date	ate Time Weather		Mea	sured Noise	_evel	Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	10:05	Sunny	63.3	65.5	58.8		63.3 Measured ≤ Baseline					
8-Feb-11	9:10	Sunny	65.3	67.7	60.7	66.1	65.3 Measured ≤ Baseline					
14-Feb-11	10:00	Cloudy	68.0	70.3	60.9	00.1	63.5					
22-Feb-11	10:00	Cloudy	67.0	68.9	62.0		59.7					

Location NC6	Location NC6 - Rosaryhill School											
					Unit:	dB (A) (30-min)						
Date	Time	Weather	Mea	sured Noise I	_evel	Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	10:45	Sunny	62.3	64.1	57.0		62.3 Measured ≤ Baseline					
8-Feb-11	9:50	Sunny	63.0	65.1	58.7	64.1	63.0 Measured ≤ Baseline					
14-Feb-11	10:40	Cloudy	64.7	66.6	59.0	04.1	55.8					
22-Feb-11	10:40	Cloudy	65.3	67.4	61.7		59.1					

Location NC7	Location NC7 - Buddist Li Ka Shing Care & Attention Home for the Elderly											
					Unit:	dB (A) (30-min)						
Date	Time	Weather	Mea	sured Noise	Level	Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	13:10	Sunny	64.4	65.9	60.8		64.4 Measured ≤ Baseline					
8-Feb-11	16:15	Sunny	67.0	67.9	65.8	GE 1	62.5					
14-Feb-11	14:32	Cloudy	74.8	76.3	69.8	65.1	74.3					
22-Feb-11	17:20	Sunny	63.9	65.6	59.6		63.9 Measured ≤ Baseline					

Location NC8	Location NC8 - Marymount Secondary School										
			Unit: dB (A) (30-min)								
Date	Time	Weather	Mea	Construction Noise Level							
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}				
2-Feb-11				5	Site Closed						
8-Feb-11	15:05	Sunny	66.7	73.5	64.0		63.9				
14-Feb-11	14:30	Cloudy	65.5	68.5	58.7	63.5	61.2				
22-Feb-11	15:25	Sunny	67.0	73.6	64.2		64.4				

Location NC9	- 117 Blue F	Pool Road									
				Unit: dB (A) (30-min)							
Date	Time	Weather	Mea	sured Noise I	Construction Noise Level						
			L eq	L ₁₀	L 90	L _{eq}	L _{eq}				
2-Feb-11				5	Site Closed						
8-Feb-11	14:30	Sunny	66.2	73.4	64.0		63.1				
14-Feb-11	15:02	Cloudy	74.1	77.2	66.7	63.3	73.7				
22-Feb-11	15:58	Sunny	68.9	74.7	65.3		67.5				

Location NC10	Location NC10 - The Harbour View											
				Unit: dB (A) (30-min)								
Date	Time	Weather	Mea	sured Noise I	Level	Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	11:35	Sunny	71.4	74.5	66.7		71.4 Measured ≤ Baseline					
8-Feb-11	16:55	Cloudy	71.0	72.7	66.2	71.7	71.0 Measured ≤ Baseline					
14-Feb-11	11:35	Cloudy	71.3	74.4	67.0	11.7	71.3 Measured ≤ Baseline					
22-Feb-11	11:30	Cloudy	70.9	73.7	66.7		70.9 Measured ≤ Baseline					

Location NC1	Location NC11 - Honey Court											
				Unit: dB (A) (30-min)								
Date	Time	Weather	Mea	sured Noise	Level	Baseline Level	Construction Noise Level					
				L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	9:15	Sunny	64.8	66.7	58.9		59.7					
8-Feb-11	15:15	Sunny	66.0	68.5	63.0	63.2	62.8					
14-Feb-11	9:10	Cloudy	65.1	67.5	62.1	03.2	60.6					
22-Feb-11	9:15	Cloudy	66.0	68.1	63.2		62.8					

Location NC1	Location NC12 - Ying Wa Girl's School											
			Unit: dB (A) (30-min)									
Date	Time	Weather	Mea	sured Noise I	Level	Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	14:00	Sunny	65.2	67.7	60.9		65.2 Measured ≤ Baseline					
8-Feb-11	13:00	Sunny	64.7	67.5	60.9	67.4	64.7 Measured ≤ Baseline					
14-Feb-11	13:45	Cloudy	64.8	67.6	60.4	67.1	64.8 Measured ≤ Baseline					
22-Feb-11	13:45	Cloudy	65.7	68.4	62.6		65.7 Measured ≤ Baseline					

Location NC1	Location NC13 - Peaksville Court												
			Unit: dB (A) (30-min)										
Date	Time	Weather	Mea	sured Noise	_evel	Baseline Level	Construction Noise Level						
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}						
2-Feb-11	14:45	Sunny	68.3	71.0	63.5		65.4						
8-Feb-11	11:15	Sunny	68.6	70.9	63.0	65.0	65.9						
14-Feb-11	14:30	Cloudy	70.1	72.4	63.7	65.2	68.4						
22-Feb-11	14:30	Cloudy	69.0	71.5	64.0		66.7						

Location NC1	Location NC14 - Hong Kong Japanese School											
			Unit: dB (A) (30-min)									
Date	Time	Weather	Meas	Measured Noise Level Baseline Level Constructi								
			L _{eq}	L ₁₀	L _{eq}							
2-Feb-11	14:15	Sunny	63.3	65.7	59.7							
8-Feb-11	15:45	Sunny	62.3	63.5	58.8	60.8	57.0					
14-Feb-11	15:42	Cloudy	65.2	69.9	64.4	00.6	63.2					
22-Feb-11	16:34	Sunny	65.4									

Location NC1	Location NC15 - Hong Kong Academy												
					Unit:	dB (A) (30-min)							
Date	Time	Weather	Mea	sured Noise	Level	Baseline Level	Construction Noise Level						
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}						
2-Feb-11	17:50	Cloudy	65.7	67.9	61.7		61.7						
8-Feb-11	16:05	Sunny	66.2	68.8	63.7	63.5	62.9						
14-Feb-11	17:30	Cloudy	66.0	68.6	62.5	03.5	62.4						
22-Feb-11	17:15	Cloudy	65.9	68.5	62.6		62.2						

					Unit:	dB (A) (30-min)	
Date	Time	Weather	Mea	sured Noise I	Level	Baseline Level	Construction Noise Level
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}
2-Feb-11	15:30	Sunny	63.0	65.0	57.6		63.0 Measured ≤ Baseline
8-Feb-11	10:35	Sunny	63.7	65.8	59.0	70.4	63.7 Measured ≤ Baseline
14-Feb-11	15:15	Cloudy	64.0	66.5	58.9	70.4	64.0 Measured ≤ Baselin
22-Feb-11	15:15	Cloudy	65.3	67.2	60.9		65.3 Measured ≤ Baselin

Location NC1	Location NC17 - Hong Kong Institute of Technology											
				Unit: dB (A) (30-min)								
Date	Time	Weather	Mea	Measured Noise Level Baseline Level Cons								
				L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	16:20	Sunny	67.0	69.4	64.0		60.1					
8-Feb-11	13:45	Sunny	67.2	69.9	63.7	66.0	61.0					
14-Feb-11	16:00	Cloudy	67.6	71.4	64.0	66.0	62.5					
22-Feb-11	15:55	Cloudy	68.3	71.0	64.7		64.4					

Location NC1	Location NC18 - Blk A, 80 Robinson Road											
				Unit: dB (A) (30-min)								
Date	Time	Weather	Measured Noise Level			Baseline Level	Construction Noise Level					
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}					
2-Feb-11	17:00	Cloudy	70.2	73.0	66.3		68.7					
8-Feb-11	14:25	Sunny	69.6	72.4	65.3	64.8	67.9					
14-Feb-11	16:40	Cloudy	72.0	75.1	67.6	04.0	71.1					
22-Feb-11	16:35	Cloudy	71.4	74.5	67.0		70.3					

Location NC19 - Villa Veneto									
			Unit: dB (A) (30-min)						
Date	Time	Weather	Measured Noise Level			Baseline Level	Construction Noise Level		
			L _{eq}	L ₁₀	L 90	L _{eq}	L _{eq}		
2-Feb-11	9:20	Sunny	64.7	67.1	60.5		64.7 Measured ≤ Baseline		
8-Feb-11	10:30	Sunny	63.2	64.7	59.8	68.6	63.2 Measured ≤ Baseline		
14-Feb-11	10:35	Cloudy	66.7	67.8	59.7	00.0	66.7 Measured ≤ Baseline		
22-Feb-11	9:05	Sunny	64.5	67.3	58.8		64.5 Measured ≤ Baseline		

Location GNC7 - Hong Villa											
			Unit: dB (A) (30-min)								
Date	Time	Weather	Measured Noise Level								
			L _{eq}	L ₁₀	L 90						
2-Feb-11	11:37	Sunny	56.1	57.2	51.7						
8-Feb-11	9:00	Sunny	56.2	59.7	54.2						
14-Feb-11	9:00	Cloudy	56.6	59.7	55.8						
22-Feb-11	10:30	Sunny	56.6	59.7	55.8						

(Restricted Hours - 07:00 to 23:00 holidays & 19:00 to 23:00 on all other days)

Data Time	e Weather		dB (A) (5-min)		(Reference) Baseline Level	(Reference)	
Date	Date Time \	vveatner	L eq	L ₁₀	L 90	Average L _{eq}	L eq	Construction Noise Level, Le
	19:00		66.3	68.8	63.0			
2-Feb-11	19:05	Cloudy	66.0	68.4	63.2	66.0		52.5
	19:10		65.8	68.3	62.7			
	10:00		64.7	66.4	62.3			
6-Feb-11	10:05	Fine	64.0	66.1	62.2	64.4		64.4 Measured ≤ Baseli
	10:10		64.5	66.4	62.3			
	19:00		65.8	68.4	62.7			
8-Feb-11	19:05	Cloudy	66.0	68.3	62.2	66.0		52.5
	19:10		66.3	68.9	62.8			
	10:00		64.9	67.8	58.3			
13-Feb-11	10:05	Cloudy	64.8	67.6	57.6	65.0		65.0 Measured ≤ Baseli
	10:10		65.3	68.4	58.8		65.8	
	19:00		67.1	69.7	63.4		8.60	
14-Feb-11	19:05	Cloudy	67.6	70.0	64.0	67.2	67.2	61.6
	19:10		67.0	69.4	63.0			
	9:40		64.7	69.2	58.2			
20-Feb-11	9:45	Cloudy	65.5	68.9	58.7	65.1		65.1 Measured ≤ Baseli
	9:50		65.2	68.4	58.4			
	19:00		67.0	69.4	63.2			
22-Feb-11	19:05	Cloudy	66.8	69.0	64.0	67.0	60.8	60.8
	19:10	1 1	67.1	69.6	64.3	1		
	9:25		64.6	68.2	59.3	64.9		
27-Feb-11	9:30	Sunny	65.3	69.4	61.5			64.9 Measured ≤ Baseli
	9:35	1 1	64.9	68.8	60.1			1

(Restricted Hours - 07:00 to 23:00 holidays & 19:00 to 23:00 on all other days)

Date Time			dB (A) (5-min)		Baseline Level	Construction Noise Level	
	Weather	L eq	L ₁₀	L 90	Average L _{eq}	L eq	L eq	
	19:35		64.7	66.8	60.0			
2-Feb-11	19:40	Cloudy	64.3	66.5	60.2	64.5		63.0
	19:45		64.6	66.6	60.3			
	10:35		63.5	65.7	60.0			
6-Feb-11	10:40	Fine	63.1	65.4	59.4	63.3		61.2
	10:45		63.3	65.6	59.6			
	19:40		63.9	66.5	60.0			
8-Feb-11	19:45	Cloudy	63.3	66.0	59.8	63.6		61.7
	19:50		63.5	66.1	60.0			
	10:45		59.2	61.9	53.2			
13-Feb-11	10:50	Cloudy	58.3	61.4	53.0	58.7		58.7 Measured ≤ Baselin
	10:55		58.5	60.9	53.6		59.1 62.	
	19:35		64.7	66.9	60.0			
14-Feb-11	19:40	Cloudy	64.2	66.0	59.6	64.3		62.7
	19:45		64.0	65.9	59.4			
	10:20		58.6	60.9	54.4			
20-Feb-11	10:25	Cloudy	59.2	61.0	55.0	58.7		58.7 Measured ≤ Baselin
	10:30		58.2	60.7	54.1			
	19:35		64.7	66.9	60.8			
22-Feb-11	19:40	Cloudy	64.5	66.5	61.2	64.5		63.0
	19:45		64.4	66.3	60.5			
	10:20		59.4	61.9	55.3			
27-Feb-11	10:25	Sunny	58.4	61.6	55.0	58.8		58.8 Measured ≤ Baselin
	10:30		58.5	61.9	55.5			

(Restricted Hours - 07:00 to 23:00 holidays & 19:00 to 23:00 on all other days)

ocation NC3	- Outside A	egean Terrace						
Date Time				dB (A) (5-min)		Baseline Level	Construction Noise Lev
	Weather	L eq	L ₁₀	L 90	Average L _{eq}	L eq	L eq	
	20:25		49.6	51.5	47.0			
2-Feb-11	20:30	Cloudy	49.3	51.0	47.1	49.5		49.5 Measured ≤ Base
	20:35		49.7	52.0	47.2			
	11:30		51.4	53.7	48.6			
6-Feb-11	11:35	Fine	51.6	53.9	48.9	51.3		51.3 Measured ≤ Basel
	11:40		51.0	53.4	48.2			
	20:20		49.6	51.7	47.0			
8-Feb-11	20:25	Cloudy	49.8	51.8	47.8	49.8		49.8 Measured ≤ Base
	20:30	, i	49.9	51.7	47.9			
	11:40		51.6	53.7	48.7	52.2		
13-Feb-11	11:45	Cloudy	52.1	54.2	49.4			52.2 Measured ≤ Base
	11:50		52.8	54.6	49.5		53.8	
	20:20		49.7	51.3	47.0			
14-Feb-11	20:25	Cloudy	49.9	51.1	48.0	49.7	49.7 Measured ≤ Base	
	20:30		49.6	51.0	48.3			
	11:10		53.2	55.1	48.9			
20-Feb-11	11:15	Cloudy	53.9	55.8	48.3	53.7	53.7 Measured ≤	53.7 Measured ≤ Base
	11:20	1	54.0	56.1	49.6			
	20:15		50.3	52.1	46.7			
22-Feb-11	20:20	Cloudy	50.5	52.5	47.0	50.3	50.3 Measured ≦ E	50.3 Measured ≤ Base
	20:25	1 1	50.1	52.0	46.5			
	11:25		52.8	55.0	48.9			
27-Feb-11	11:30	Sunny	53.2	55.5	49.3	53.1		53.1 Measured ≤ Base
	11:35		53.4	55.7	49.8	1		

(Restricted Hours - 23:00 to 07:00 on all days)


	10/		dB (A) (5-min)		(Reference) Baseline Level	(Reference)	
Date	Time	Weather	L eq	L ₁₀	L 90	Average L _{eq}	L _{eq}	Construction Noise Level, Leg
	23:00		59.3	61.7	56.5			
2-Feb-11	23:05	Cloudy	60.2	62.8	57.4	59.9	1	59.9 Measured ≦ Baseline
	23:10		60.2	62.8	57.3			
	23:00		59.4	61.2	57.2		60.7	59.3 Measured ≦ Baseline
8-Feb-11	23:05	Fine	59.4	61.2	57.1	59.3		
	23:10		59.0	61.0	56.8			
	23:30		60.4	64.6	55.3		00.7	
14-Feb-11	23:35	Fine	61.2	65.0	55.4	60.7		60.7 Measured ≤ Baselin
	23:40		60.6	64.4	54.7			
	23:35		61.4	63.8	55.8			
22-Feb-11	23:40	Fine	60.5	63.7	55.2	60.7	ĺ	60.7 Measured ≤ Baseline
	23:45		60.0	63.3	54.9			


(Restricted Hours - 23:00 to 07:00 on all days)


Date	Time	Weather	dB (A) (5-min)				Baseline Level	Construction Noise Leve
Date	rime	vveatner	L eq	L ₁₀	L 90	Average L _{eq}	L eq	L eq
	23:35		52.3	55.9	51.0			
2-Feb-11	23:40	Cloudy	52.6	56.0	51.4	52.7		52.7 Measured ≤ Baseline
	23:45	1	53.1	56.4	52.0			
	23:35		51.6	54.0	48.9			52.2 Measured ≤ Baselin
8-Feb-11	23:40	Fine	51.8	54.4	49.0	52.2		
	23:45		53.0	55.1	49.5		53.9	
	23:00		53.7	55.8	50.0		30.8	53.1 Measured ≦ Baseline
14-Feb-11	23:05	Fine	53.2	56.4	49.4	53.1	53.1	
	23:10		52.1	56.1	49.2			
	23:00		53.9	57.2	49.7			
22-Feb-11	23:05	Fine	53.9	57.0	49.6	53.7		53.7 Measured ≤ Baselii
	23:10		53.4	56.6	47.4			

(Restricted Hours - 23:00 to 07:00 on all days)

D-4-	T:			dB (A) (5-min)		Baseline Level	Construction Noise Leve
Date	Time	Weather	L eq	L ₁₀	L 90	Average L _{eq}	L _{eq}	L eq
	0:20		51.4	53.6	49.3			
3-Feb-11	0:25	Cloudy	52.0	54.1	49.5	51.9		51.9 Measured ≤ Baseline
	0:30	1	52.2	54.2	49.7			
	0:25		50.5	52.8	48.4			
9-Feb-11	0:30	Fine	50.2	52.7	48.0	50.2	52.0	50.2 Measured ≤ Baseline
	0:35	1	50.0	52.6	47.9			
	0:20		50.2	51.9	47.9		32.0	
15-Feb-11	0:25	Fine	50.8	52.1	48.2	50.9		50.9 Measured ≤ Baseline
	0:30		51.7	52.9	48.5			
	0:25		50.9	52.6	47.9			
23-Feb-11	0:30	Fine	51.3	53.4	48.5	51.2		51.2 Measured ≤ Baseline
	0:35		51.4	53.8	48.7			

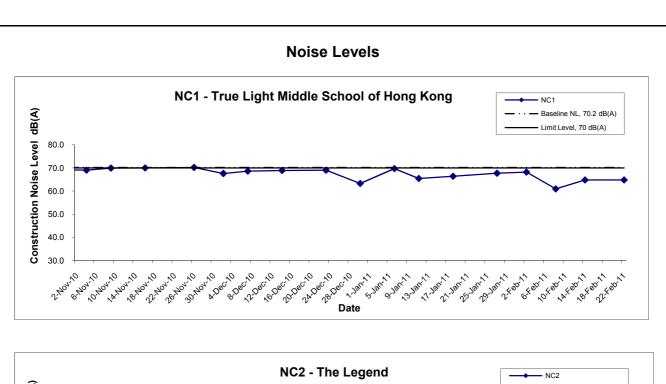

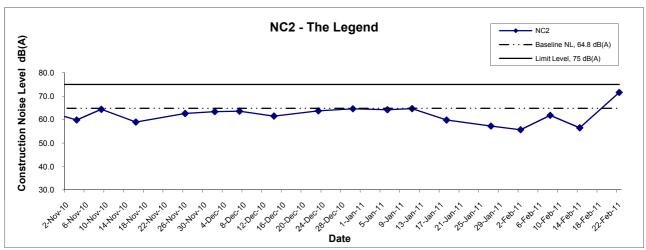

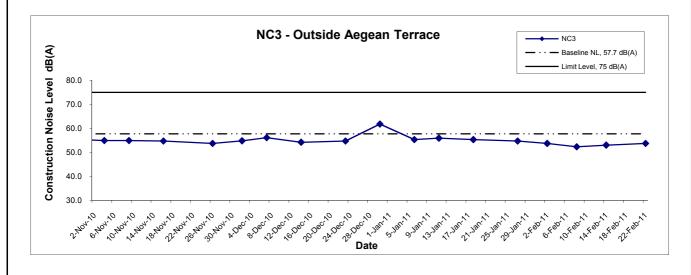



Title Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results


 Scale
 Project No.
 MA8001

 Date
 Feb 11
 Appendix
 G



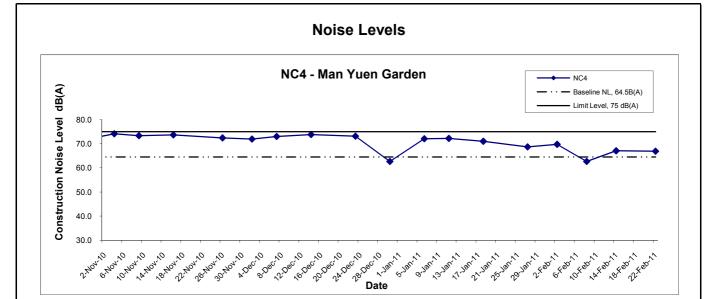

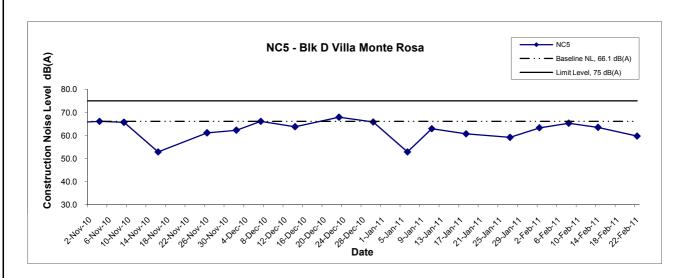

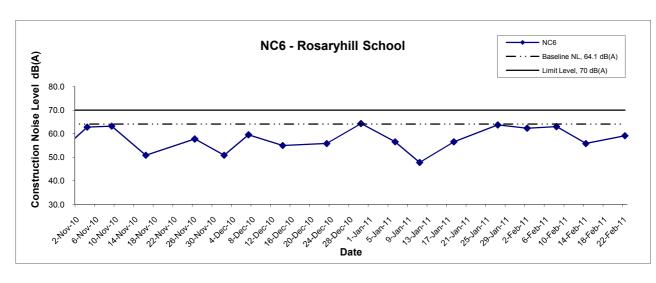


Title Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results


 Scale
 Project No.
 MA8001


 Date
 Feb 11
 Appendix G





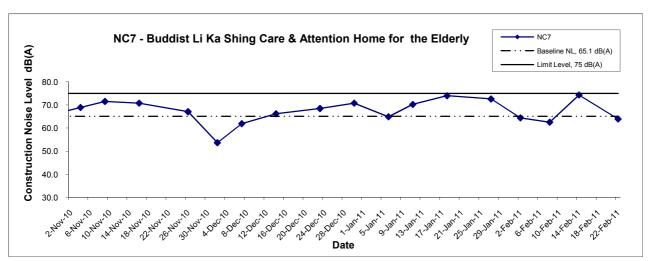

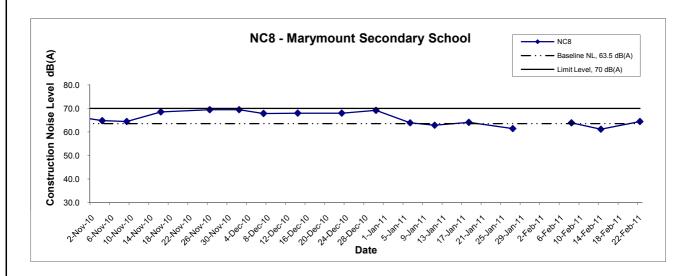

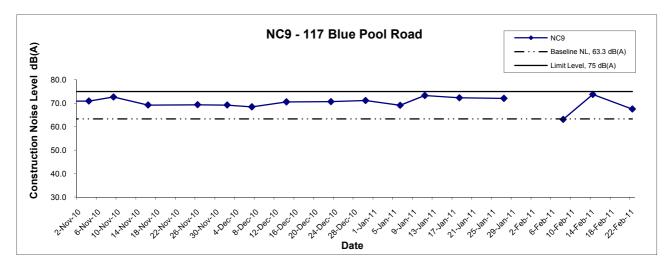


Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results

Title


 Scale
 Project No.
 MA8001


 Date
 Feb 11
 Appendix
 G



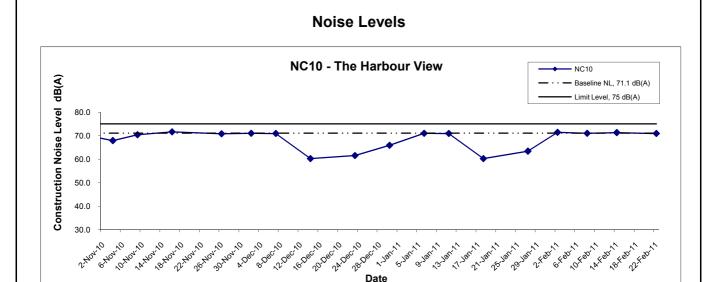

Date

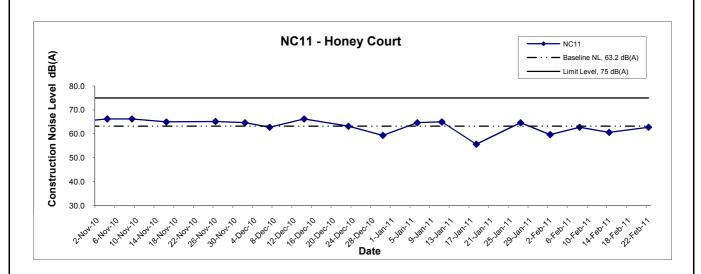


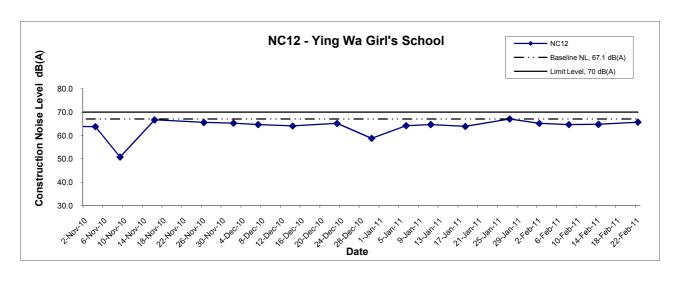



Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results

Scale Project No. MA8001 N.T.S Date Appendix G Feb 11



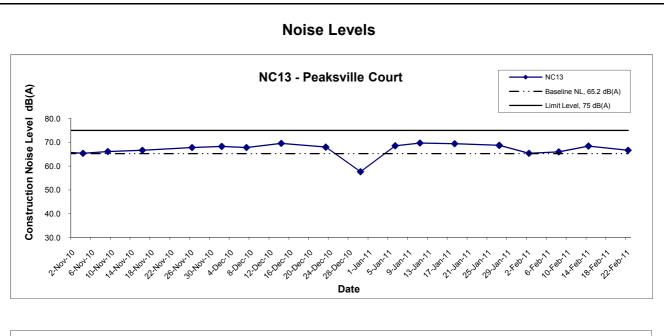

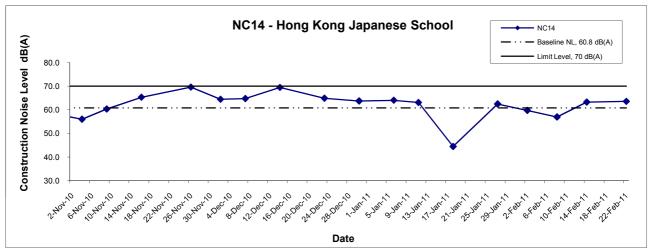

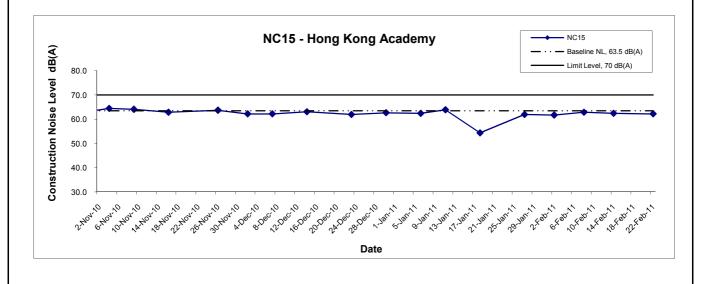


Title Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results


 Scale
 Project No.
 MA8001


 Date
 Feb 11
 Appendix G





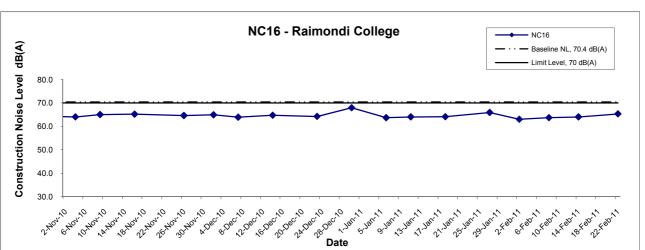

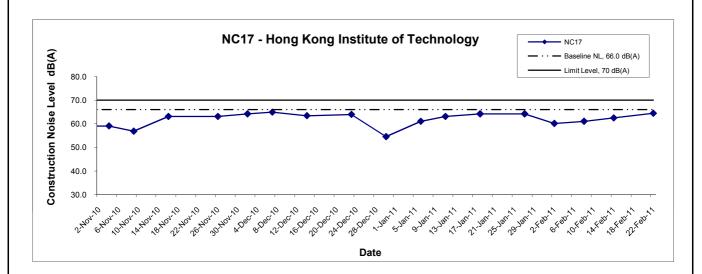

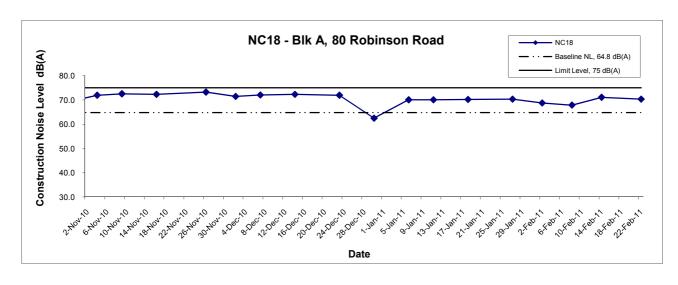


Title Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results

 Scale
 Project No.
 MA8001

 Date
 Feb 11
 Appendix G




Noise Levels

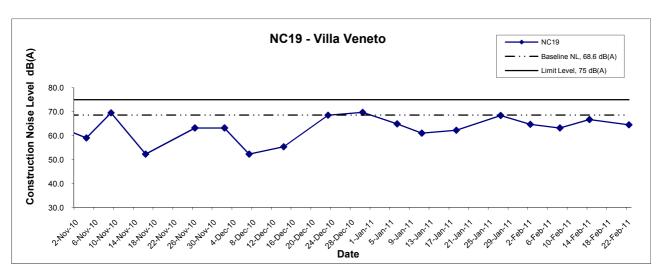




Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results


Title






Noise Levels (Restricted Hours - 07:00 - 23:00 holidays & 19:00 - 23:00 on all other days)

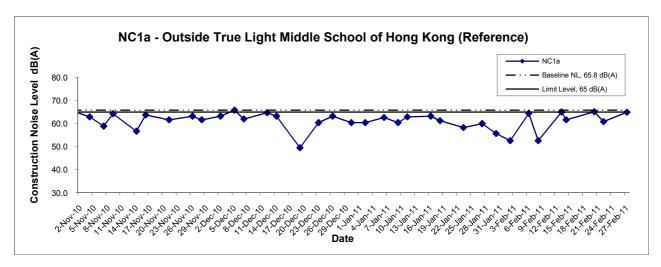


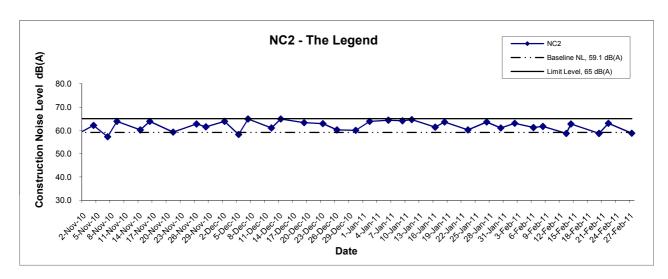


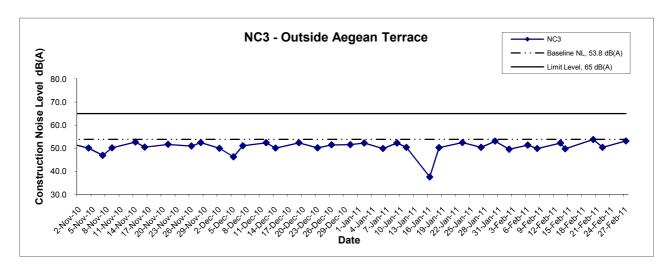


Title	Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel	Scale	N.T.S	Project No. MA8001	CINICITCOL
	Graphical Presentation of Construction Noise Monitoring Results	Date	Feb 11	Appendix G	

Noise Levels (Restricted Hours - 23:00 to 07:00 on all days)

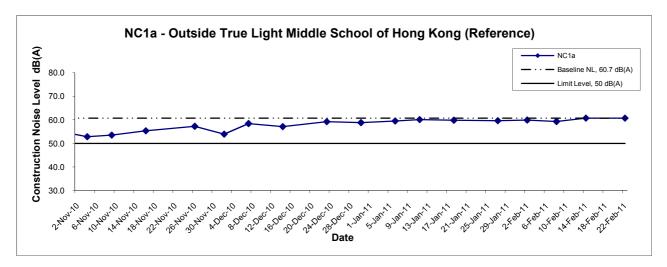

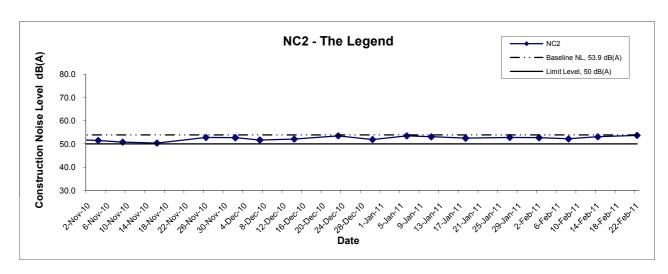

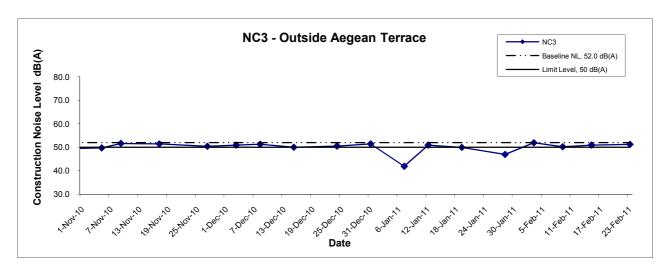

Title Contract No. DC/2007/10
Design and Construction of Hong Kong West Drainage Tunnel
Graphical Presentation of Construction Noise Monitoring
Results

 Scale
 Project

 N.T.S
 No.
 MA8001

 Date
 Appendix
 G



APPENDIX H SUMMARY OF EXCEEDANCE

Contract No. DC/2007/10 – Design and Construction of Hong Kong West Drainage Tunnel Exceedance Report

Eastern Portal

- (A) Exceedance Report for Air Quality (1 hour TSP) (NIL in the reporting month)
- (B) Exceedance Report for Air Quality (24 hours TSP) (NIL in the reporting month)
- (C) Exceedance Report for Construction Noise (NIL in the reporting month)

Western Portal

- (D) Exceedance Report for Air Quality (1 hour TSP) (NIL in the reporting month)
- (E) Exceedance Report for Air Quality (24 hours TSP) (NIL in the reporting month)
- (F) Exceedance Report for Construction Noise (One Action Level exceedance was recorded for the complaint received on 25 February 2011)

Intake DG1

(G) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake E5A

(H) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake E7

(I) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake MA14

(J) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake PFLR1

(K) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake RR1

(L) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake THR2

(M) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake W0

(N) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake W5

(O) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake P5

(P) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake W8

(Q) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake BR6

(R) Exceedance Report for Construction Noise (NIL in the reporting month)

Intake GL1

(S) Exceedance Report for Construction Noise (One Action Level exceedance was recorded for the complaint received on 18 February 2011)

APPENDIX I SITE AUDIT SUMMARY

Design and Construction of Hong Kong West Drainage Tunnel

Weekly Site Inspection Record Summary Inspection Information

Checklist Reference Number	110210
Date	10 February 2011
Time	9:00 – 18:00

Doc No	Now Compliance	Related
Ref. No.	Non-Compliance None identified	Item No.
-	None identified	Related
Ref. No.	Remarks/Observations	Item No.
	A. Water Quality	144 1 (01
	No environmental deficiency was identified during site inspection.	
	·	
	B. Air Quality	
	No environmental deficiency was identified during site inspection.	
	C. Noise	
	No environmental deficiency was identified during site inspection.	
	• No environmental deficiency was identified during site inspection.	
	D. Waste / Chemical Management	
	No environmental deficiency was identified during site inspection.	
	January Market and By John Barpetton.	
	E. Ecology	
	No environmental deficiency was identified during site inspection.	
	F. Marine Ecology	
	No environmental deficiency was identified during site inspection.	
110210 001	G. Reminders	
110210-R01	Clear the oil leakage from the mobile crane at Intake PFLR1.	F8
110210-R02	Provide sedimentation facilities at Intake B2.	B7i.
110210-R03	• Ensure the site discharge from the sedimentation tank comply with WPCO licenses at Intake BR6.	В9
110210-R04	Provide sand bag/concrete bund to protect the existing drain at Intake DG1.	B5
110210-R05	Clear the deposited silt at the wheel washing bay at Intake GL1.	В9
110210-R06	To repair the damage part of the drip tray at Intake E5A.	F8
	H. Others	
	Follow-up on previous audit section (Ref. No.:110131), all environmental deficiencies were improved/rectified by contractor during the site inspection.	

	Name	Signature	Date
Recorded by	Ivy Tam	W	10 February 2011
Checked by	Dr. Priscilla Choy	WI	10 February 2011

Weekly Site Inspection Record Summary (For Western Portal Only)

Inspection Information

Checklist Reference Number	110208
Date	8 February 2011 (Tuesday)
Time	15:00-15:30

		Related
Ref. No.	Non-Compliance	Item No.
-	None identified	-
		Related
Ref. No.	Remarks/Observations	Item No.
	A. Water Quality	
	No environmental deficiency was identified during site inspection.	
	G. Reminders	·
	No environmental deficiency was identified during site inspection.	
	H. Others	
	• NIL	

	Name	Signature	Date
Recorded by	Yeung Wing Kun	Oan	8 February 2011
Checked by	Dr. Priscilla Choy	WI	8 February 2011

Design and Construction of Hong Kong West Drainage Tunnel

Weekly Site Inspection Record Summary Inspection Information

Checklist Reference Number	110218	
Date	18 February 2011	
Time	9:00 - 17:30	

Ref. No.	Non-Compliance	Related
-	None identified	Item No.
Ref. No.	Remarks/Observations	Related Item No.
	A. Water Quality	
	No environmental deficiency was identified during site inspection.	
	B. Air Quality	
110218-001	Dust generation was observed during the grouting works at PFLR1. The Contractor was reminded to provide three-side enclosure with top shelter to avoid dust dispersion.	D10
	C. Noise	
	No environmental deficiency was identified during site inspection.	
	D. Waste / Chemical Management	
	No environmental deficiency was identified during site inspection.	
	E. Ecology	
	No environmental deficiency was identified during site inspection.	
	F. Marine Ecology	
	No environmental deficiency was identified during site inspection.	
	G. Reminders	
110218-R02	Ensure the site discharge from the sedimentation tank comply with WPCO license at Intake BR6.	В9
110218-R03	To clear the diesel oil within the u-channel at GL1.	F9
110218-R04	To clear the deposited mud inside the sedimentation tank at THR2.	В9
110218-R05	To clear the discarded leaves inside the wheel washing facility at MBD2.	Fli.
110218-R06	The air compressor should be provided with valid noise label at PFLR1.	E8
110218-R07	The sedimentation facility should be provided at M3.	B1
	H. Others	
	• Follow-up on previous audit section (Ref. No.:110210), follow-up action is needed for the item (110210 - R03).	

	Name	Signature	Date
Recorded by	TY Yeung	Jan	- 18 February 2011
Checked by	Dr. Priscilla Choy	WL	18 February 2011

Weekly Site Inspection Record Summary (For Western Portal Only)

Inspection Information

Checklist Reference Number	110215
Date	15 February 2011 (Tuesday)
Time	14:00-14:30

		Related
Ref. No.	Non-Compliance	Item No.
-	None identified	-
		Related
Ref. No.	Remarks/Observations	Item No.
	A. Water Quality	
	No environmental deficiency was identified during site inspection.	
	G. Reminders	
	No environmental deficiency was identified during site inspection.	
	H. Others	
	• NIL	

	Name	Signature	Date
Recorded by	Yeung Wing Kun	Gun	15 February 2011
Checked by	Dr. Priscilla Choy	WL	15 February 2011

1

Weekly Site Inspection Record Summary Inspection Information

Checklist Reference Number	110224
Date	24 February 2011
Time	14:00 – 17:00

D.C.N.	N. C. II	Related
Ref. No.	Non-Compliance	Item No.
-	None identified	-
D.C.M.	Personal of Ohean work hours	Related
Ref. No.	Remarks/Observations	Item No.
	A. Water Quality No environmental deficiency was identified during site inspection.	
	• No environmental defictency was identified during site inspection.	
	B. Air Quality	
	No environmental deficiency was identified during site inspection.	
	C. Noise	
	No environmental deficiency was identified during site inspection.	
	D. Waste / Chemical Management	
	No environmental deficiency was identified during site inspection.	
	E. Ecology	
	No environmental deficiency was identified during site inspection.	
	F. Marine Ecology	
	No environmental deficiency was identified during site inspection.	
	G. Reminders	
110224-R01	Clear the stagnant water regularly at Eastern Portal.	B15
110224-R02	Cleat the oil stain at underneath the mobile crane at E5A.	F8
110224-R03	Provide sand bag temporarily at MB16 for avoiding the silty water direct to the gully.	B2
110224-R04	Clear the discarded leaves along the u-channel at MBD2.	Fli.
	H. Others	
110224-F05	• Follow-up on previous audit section (Ref. No.:110218), Intake PFLR1, BR6, GL1, THR2 and M3 were not observed during the site inspection. Follow-up action is needed for all outstanding items.	

	Name	Signature	Date
Recorded by	TY Yeung	Jan.	24 February 2011
Checked by	Dr. Priscilla Choy	WI	24 February 2011

Weekly Site Inspection Record Summary (For Western Portal Only)

Inspection Information

Checklist Reference Number	110223
Date	23 February 2011 (Wednesday)
Time	14:00-14:30

		Related
Ref. No.	Non-Compliance	Item No.
-	None identified	-
		Related
Ref. No.	Remarks/Observations	Item No.
	A. Water Quality	
	No environmental deficiency was identified during site inspection.	
·····	G. Reminders	
	No environmental deficiency was identified during site inspection.	
	H. Others	
	• NIL	

	Name	Signature	Date
Recorded by	Yeung Wing Kun	Glin	23 February 2011
Checked by	Dr. Priscilla Choy	WI	23 February 2011

APPENDIX J ENVIRONMENTAL MITIGATION IMPLEMENTATION SCHEDULE (EMIS)

Appendix J - Summary of Environmental Mitigation Implementation Schedule

Types of Impacts	Mitigation Measures	Status
Construction Dust	Pust Mitigation Measures The Contractor shall undertake at all times to prevent dust nuisance as a result of his activities. Effective dust suppression measures should be installed to minimize air quality impacts, at the boundary of the site and at any sensitive receivers. No blasting shall be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted (unless prior permission of the Commissioner of Mines is obtained). Effective water sprays shall be used during the delivery and handling of all raw sand, aggregate and other similar materials, when dust is likely to be created, to dampen all stored materials during dry and windy weather. Watering of exposed surfaces shall be conducted as often as possible depending on the circumstances. A watering programme of once every 2 hours in normal weather conditions, and hourly in dry/windy conditions. Any stockpile of dusty material cannot be immediately transported out of the Site shall be either: a) covered entirely by impervious sheeting; b) placed in an area sheltered on the top and the three sides; or c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet. Should a conveyor system be used, the Contractor shall implement the following precautionary measures. Conveyor belts shall be fitted within windboards. Conveyor transfer points and hopper discharge areas shall be enclosed to minimize dust emission. All conveyors under control of the Contractor, and carrying materials which have the potential to create dust, shall be totally enclosed and fitted with belt cleaners. Any dusty materials being discharged to vehicle from a conveying system at fixed transfer point, three-sided roofed enclosed with a flexible curtain across the entry shall be provided. Exhaust fans shall be provided for this enclosure and vented via a suitable fabric filter system. The heights from excavated spoils are dropped should be minimise to reduce the fugitive dust arising from unloading/loading. The Contr	*
	 Chemical wetting agents shall only be used on completed cuts and fills to reduce wind erosion. 	N/A

N/A Not Applicable at this stage;

* Non-compliance but rectified by the contractor;

Recommendation was made during site audit but improved/rectified by the contractor;

[#] Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	No vehicle exhausts shall be directed towards the ground or downwards to minimize dust nuisance.	٨
	• Ventilation system, equipped with proprietary filters, should be provided to ensure the safe working environment inside the tunnel. Particular attention should be paid to the location and direction of the ventilation exhausts. The exhausts should not be allowed to face any sensitive receivers directly. Consideration should also be given to the location of windows, doors and direction of prevailing winds in relation to the nearby sensitive receivers.	٨
	• In the event of any spoil or debris from construction works being deposited on adjacent land, or stream, or any silt being washed down to any area, then all such spoil, debris or material and silt shall be immediately removed and the affected land and areas restored to their natural state by the Contractor to the satisfaction of the Engineers.	۸
	In addition, based on the Air Pollution Control (Construction Dust) Regulation, any works involved regulatory and notifiable works, such as stockpiling, loading and unloading of dusty materials, shall take precautions to suppress dust nuisance.	
	• The working area of any excavation or earthmoving operation shall spray with water or a dust suppression chemical immediately before, during and immediately after the operation so as to maintain the entire surface wet;	۸
	• Exposed earth shall be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies; and	٨
	• Any stockpile of dusty materials (greater than 20m³) shall be either covered entirely by impervious sheeting or placed in an area sheltered on the top and three sides; and sprayed with water or a dust suppression chemical so as to maintain the entire surface wet.	٨
	• Other suitable dust control measures as stipulated in Air Pollution Control (Construction Dust). Regulation, where appropriate, should be adopted.	۸

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

Recommendation was made during site audit but improved/rectified by the contractor;

Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
-	can also be reduced by construction of temporary noise barriers which screen the lower floors from viewing the sites. Temporary noise barriers should be installed at active parts of construction areas where construction equipment is being operated in close proximity to NSRs.	
	• It is noted that under the WBTC No. 19/2001, all construction sites are required to use metallic site hoarding can be slightly modified (with the addition of steel backings) into temporary noise barriers. These barriers should be gap free and have a surface mass density of at least 7kg/m ² .	۸
	• All hand-held percussive breakers and air compressors should comply the Noise Control (Hand-held Percussive Breakers) Regulations respectively under the NCO (Ordinance No. 75/88, NCO Amendment 1992 No.6).	٨
	The Contractor shall devise, arrange methods of working and carry out the works in such manner as to minimise noise impacts on the surrounding environment, and shall provide experienced personnel with suitable training to ensure that these measures are implemented properly.	۸
	Level 2 Use of Barriers	
	Level 2 mitigation measures include providing movable barriers for sites which have sufficient space for installation, full enclosures during the drilling activities at Eastern Portal and at muck pit areas for Eastern portals and cantilever-typed high rise noise barrier for intake W5 (P) and W8.	۸
	Before construction of the full enclosure at muck pit area, the use of full enclosure noise barrier (Stage A) for the drilling activities at the Eastern Portal area is required. A full enclosure for the muck pit area will then be constructed at this later stage (Stage B). The full enclosure shall be gap free apart from necessary entrance/exits, which shall face towards the entrance of eastern portal to minimize the amount of noise generated from affecting the nearest RNSRs especially school (True Light Middle School of Hong Kong).	^
	5m high cantilever-typed hoarding barrier to be built at W5 (P) and W8. These enclosures/barriers should have no gaps and have a superficial surface density of at least 10kg/m². Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period. To schedule the noise barrier erection and dismantling to the non sensitive periods of school to avoid adverse impact to W8/3.	۸
	Movable barriers of 3 to 5m height with a small cantilevered upper portion and skid footing to be located within about 5 m or more for mobile equipment such that the line of sight is blocked. To provide purposes-built noise barriers or screens constructed of appropriate materials (minimum superficial density of 10kg/m^2) located close to the operating PME.	۸
	Pre-drilling following by chemical splitting instead of using large excavator mounted breaker should be used as mitigation measure for rock breaking and rock drilling.	۸

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	No construction activity is recommended during the examination period.	٨
	Ground borne noise	
	The noise level should be measured on the ground floor inside the nearest building during the TBM construction work in the daytime. If the daytime monitored ground borne noise exceeds the relevant evening/night ground borne noise criteria, evening/night construction work would not be carried out for the concerned tunnel section. Evening/night time construction work is subject to CNP application under the control of NCO.	۸
	Public relationship strategy with 24-hour hotline system.	

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Water Quality	Precautionary measures for construction work near natural streams The government provides guidelines (ETWB TCW NO. 5/2005 and DSD TC 2/2004) are providing guidelines to minimize impacts when there is construction work carried out at near natural streams course. Relevant mitigation measures for the intakes are summarised as follows: • Temporary site access to the work sites should be carefully planned and located to minimize disturbance caused to the substrates of streams/rivers and riparian vegetation by construction plant. • Locations well away from the rivers/streams for temporary storage of materials (e.g equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil should be identified before commencement of works. • Proposed works site areas inside, or in the proximity of, natural rivers and streams should be temporarily isolated to prevent adverse impacts on the stream water qualities. • Stockpiling of construction materials, if necessary, should be completely properly covered and located away from any natural stream/river. • Construction debris and spoil should be covered up and/or properly disposed of as soon as possible to avoid being washed into nearby rivers/streams by rain and local runoff. Construction of temporary berthing point at the Western Portal A refuse collection vessel shall be provided to collect refuse or materials lost into the sea. The respective areas of the marine works will be completely enclosed by the silt curtain. The curtain shall be extended from water surface down to the seabed where it is anchored using sinker blocks. The Contractor shall inspect the silt curtain on regular basis to ensure its integrity and it is serviceable for all times.	^ ^ ^ ^ N/A

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	Transfer of armour rock onto the seabed from barge at the temporary pier location should be conducted by careful grabbing and unloading to the seabed (to minimize sediment migration).	٨
	The conveyor belt should be completely covered and muddy effluent from the temporary barge should be contained, treated and disposed. Where there is transfer of excavated wastes, the Contractor should provide appropriate measures to ensure that the waste is free from floatables, putrescibes, organic wastes and toxic materials and when required a refuse collection vessel be provided to collect float refuse.	٨
	Construction of stilling basin at Western Portal outfall	
	All construction for the basin should be carried out inside the temporary cofferdam which is a temporary watertight enclosure built in the water and pumped dry to expose the bottom so that construction of stilling basin can be undertaken.	^
	During the dewatering process, appropriate desilting/sedimentation devices should be provided on site for treatment before discharge. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge.	^
	The cofferdam will remain on site until after the construction of stilling basin has been completed. The coffer dam shall be regularly inspected and maintained to ensure no spillage of waste or wastewater into the sea. Conveyance of dredged materials from the coffer dam shall be carried out cautiously to avoid spillage into the sea.	۸
	The filled material for the stilling basin should be contained inside the temporary cofferdam. The top level of the cofferdam shall be constructed higher than the final backfilled level.	۸
	The Contractor shall be responsible for the design, installation and maintenance of the silt curtains to minimize the impacts on the water quality and the protection of water quality. The design and specification of the silt curtains shall be submitted by the Contractor to the Engineer for approval.	N/A
	Silt curtains shall be formed from tough, abrasion resistant, permeable membranes, suitable for the purpose, supported on floating booms in such a way as to ensure that the sediment plume shall be restricted to within the limit of the works area. The silt curtain shall be formed and installed in such a way that tidal rise and fall are accommodated, with the silt curtains always extending from the surface to the bottom of the water column and held with anchor blocks. The removal and reinstallation of such curtains during typhoon conditions shall be as agreed with the Director of Marine Department. The contractor shall regularly inspect the silt curtains and check that they are moored and marked to avoid danger to marine traffic. Any damage to the silt curtain shall be repaired by the Contractor promptly and the works shall be stopped until the repair is fixed to the satisfaction of the Engineer.	N/A

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
•	Transfer of rock fill material (armour rock) from the barge onto the site location should be conducted by grabbing and placement on the seabed to minimize sediment migration. No free dropping of the material will be allowed.	^
	Prior to the construction of armor rock based panel, a silt curtain shall also be installed prior to carry out any marine works as a preventive mitigation measure.	N/A
	Construction of TBM tunnel at both portals and intakes	
	Recycled water will be used at the cutter face for cooling purposes. Used water will be collected and discharged to a settling tank for settlement. Excess water from the settling tank will be transferred to the water treatment plant on site where the addition of flocculants will assist in settlement of solids. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge.	۸
	During the drilling process, all flushing water will be recycled for use. Discharge of the treated water to nearby drainage system shall be allowed provided that it has been treated to a level meeting with statutory requirements.	^
	Water flow at streams should be maintained by a temporary diversion system during the construction phase of intakes and manhole drop shafts.	^
	General Construction Activities and Workforce	
	A. Surface runoff	
	Effluent produced from construction activities are subjected to WPCO control. Effluent produced from sites should be diverted away from stream courses. Construction works near stream course should be scheduled in the dry season as far as practical to avoid excessive site runoff discharge.	*
	Under the <i>Water Pollution Control Ordinance</i> (WPCO), turbid water from construction sites must be treated to minimize the solids content before being discharged into storm drains. The suspended solids load can be reduced by directing the runoff into temporary sand traps or other silt-removal facilities, and other good and appropriate site management practices. Advice on the handling and disposal of construction site discharge is provided in the ProPECC Paper (PN 1/94) on Construction Site Drainage.	*
	A drainage system layout should be prepared by the Contractor for each of the works areas (portals and intakes), detailing the facilities and measures to manage pollution arising from surface runoff from those works areas. The drainage layout and an associated drainage management plan to reduce surface runoff sediments and pollutants entering watercourses, should be submitted to the Engineer for approval and to EPD for agreement.	*

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	The system should be capable of handling stormwater from the site and directing it to sediment removal facilities before discharge. If oil and grease is used on the site or brought to the site, the stormwater should pass through oil interceptors before discharge. The interceptors should have a bypass to prevent washout in heavy storms.	۸
	A temporary channel system or earth bunds or sand barriers should be provided in works areas on site to direct stormwater to silt-removal facilities. Stockpiled materials, if susceptible to erosion of rain or wind, should be covered with tarpaulins (or/similar fabric0 or hydroseedings as far as practicable especially during the wet season.	*
	Silt removal facilities should be checked and the deposited silt and grit should be removed regularly to ensure these facilities are in good working condition and to prevent blockages.	*
	Vehicle washing areas should be drained into a settlement into a settlement basin to settle out the suspended solid before discharge to storm water drains. The water should be recycled on site whenever possible. It is suggested that the wash water from the wheel wash basin is either reused for road watering or pumped to the on-site settling tanks for treatment. Water used for dust depression purposes should be minimized and an alternative soil holding agent should be considered.	۸
	B. Spillage, Oil and Solvents Any contractor generating waste oil or other chemicals as a result of his activities should register as a chemical waste producer and provide a safe storage area for chemicals on site. Oil interceptors need to be regularly inspected and cleaned to avoid wash-out of oil during storm conditions. A bypass should be provided to avoid overload of the interceptor's capacity.	٨
	Any spillage should be cleaned up immediately and the resulting contaminated absorbent material should be properly managed according to Waste Disposal Regulations. Spills should be contained to avoid spreading and contaminating the water resources.	۸
	Oil and fuels should be used and stored properly in designated area. All fuel tanks and storage areas should be provided with locks and be sited on within sealed areas within surrounded by bunds of with a capacity equal to 110% of the storage capacity of the largest tank.	*
	Good housekeeping practices are required to minimize careless spillage and keep the work space in a tidy and clean condition. Appropriate training, including safety codes and relevant manuals, should be given to the personnel who regularly handle the chemicals on site.	^

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
•	C. On-Site Effluent Generation	
	Sewage arising from the additional population of workers on site should be collected in a suitable storage facility (chemical mobile toilets). Most of the work site locations are close to the public sewerage system, and therefore the use of septic tanks isare, therefore, not encouraged. Portable toilets should be used coupled with tickering away services provided by a licensed collector. They should be positioned at appropriate locations across the site to ensure no direct discharge of foul water off-site.	۸
	D. Protection of Existing Flora and Fauna	
	The Contractor should provide details of the plant and operation plans at each site for approval by the Engineer before commencing construction. The plans should include how the existing flora and fauna will be protected. Locations required for groundwater levels monitoring are Eastern Portal, PFLR1(P), THR2(P), TP5, TP789 and W12.	^
	The construction and demolition of the temporary pier may create short term impacts on the local marine water quality. The situation will be restored once the work is finished by proper phasing of the works programme and implementation of the adequate mitigation measures (e.g. silt curtain) the impacts will be minimized.	^
	Maintaining Baseflow in Downstream Watercourses	
	The final design will be developed during the detailed design stage. The exact base flow rates to be maintained at each of the intakes will be subject to detailed site investigation at design stage.	
	 Purpose of the by-pass device is to maintain the base-flow of the affected stream course. The by-pass system comprises an approach link and a trapezoidal channel. The approach link is section with inclined profiled surface at a gradient of 1 in 100. It is used to direct the base flow to the bypass trapezoidal channel at its down stream end during the normal days. The trapezoidal channel is sized such that it could handle the base flow in the affected stream course which is estimated to be no more than 20 l/s. Whenever the flow in the stream course exceeding the base flow rate, the excessive flow will overflow into the intake structure via the bottom rack structure. The bottom rack structure has bar screen on the top and inclined channel at the bottom. The top level of the bar screen is level with the by-pass channel with an aim to receive the overflow from the by-pass channel. The by-pass channel is designed requiring minimum maintenance. However, it is recommended that the maintenance authority carry out regular maintenance inspection prior to onset of seasons and after significant rainstorm event to prevent blockage of the by-pass and bottom rack structure. 	N/A N/A N/A N/A N/A

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

roper waste management plan should be implemented to promote waste minimisation at source. Where waste generation is voidable then the potential for recycling or reuse should be explored and opportunities taken. If wastes cannot be recycled then the ommended disposal routes should be followed. waste materials shall be segregated into categories covering: Excavated material or construction waste suitable for reuse on-site Excavated material or construction waste suitable for public filling areas Remaining C&D waste for landfill Chemical waste, and General refuse	^ ^ ^
voidable then the potential for recycling or reuse should be explored and opportunities taken. If wastes cannot be recycled then the ommended disposal routes should be followed. waste materials shall be segregated into categories covering: Excavated material or construction waste suitable for reuse on-site Excavated material or construction waste suitable for public filling areas Remaining C&D waste for landfill Chemical waste, and General refuse	^ ^
 Excavated material or construction waste suitable for reuse on-site Excavated material or construction waste suitable for public filling areas Remaining C&D waste for landfill Chemical waste, and General refuse 	^ ^
 Excavated material or construction waste suitable for public filling areas Remaining C&D waste for landfill Chemical waste, and General refuse 	^ ^
 Remaining C&D waste for landfill Chemical waste, and General refuse 	^
Chemical waste, andGeneral refuse	٨
• General refuse	
	^
composition and disposal of construction waste should be implemented. Consusts containing for inset and non-inset wastes	
per segregation and disposal of construction waste should be implemented. Separate containers for inert and non-inert wastes ald be provided. The inert waste should be taken to public filling area and the non-inert waste should be transported to strategic lifelis.	٨
ip-ticket system on the solid waste transfer/disposal operations should be included as one of the contractual requirements (ETWB W No. 31/2004). The Independent Environmental Checker (IEC) should responsible for auditing this system.	^
should also responsible for auditing the well-documented record system which includes: (i) quantity of waste generation, (ii) ntity of recycled material, (iii) quantity of disposed material, (iv) disposal methods and (v) sites should be implemented during struction phase.	٨
ular cleaning and maintenance of the waste storage area should be conducted throughout the construction stage.	٨
avated spoil	
trol measures for soil temporarily stockpiled on-site should be taken in order to minimize the noise, generation of dust, pollution vater and visual impact. Key impacts include:	^
rip W nt stru	o-ticket system on the solid waste transfer/disposal operations should be included as one of the contractual requirements (ETWB No. 31/2004). The Independent Environmental Checker (IEC) should responsible for auditing this system. Should also responsible for auditing the well-documented record system which includes: (i) quantity of waste generation, (ii) ity of recycled material, (iii) quantity of disposed material, (iv) disposal methods and (v) sites should be implemented during ruction phase. Italian cleaning and maintenance of the waste storage area should be conducted throughout the construction stage. Italian cleaning and maintenance of the waste storage area should be taken in order to minimize the noise, generation of dust, pollution

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	 Surface of stockpiled soil should be wetted with water when necessary especially during dry season Disturbance of stockpiled soil should be minimized 	^
	 Stockpiled soil should be properly covered with tarpaulins especially heavy rain storms Stockpiling areas should be enclosed if possible 	٨
	 Stockpiling location should be away from the shoreline An independent surface water drainage system equipped with silt traps should be installed at the stockpiling area 	^
	<u>Chemical wastes</u>	
	For those processes that generate chemical waste, it may be possible to find alternatives which generate reduced quantities or even no chemical waste, or less dangerous types of chemical waste.	٨
	Construction processes produce chemical waste, the contractor must register with EPD as a Chemical Waste Producer. Wastes classified as chemical wastes are listed in the Waste Disposal (Chemical Waste) (General) Regulation (CWR). It should be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Waste published by the EPD. A producer of chemical wastes should be registered as chemical waste producer and registered with EPD.	۸
	The chemical waste generated shall be properly labelled, stored and disposed of according to the CWR. Proper storage area shall be allocated on site for storage of chemical waste. The chemical waste should only be collected by a licensed collector. An updated list of licensed chemical waste collector can be obtained from EPD.	^
	In case of spillage, spill absorbent material and emulsifiers should be available on site. This material should be replaced on a regular basis and the contaminated material stored in a designated, secure place.	*
	General refuse A reputable waste collector should be employed by the contractor to remove general refuse from the site, separate from C&DM and chemical wastes, and on regular basis in order to minimize odour, pest and litter impacts. The burning of refuse at site is not permitted under the Air Pollution Control Ordinance (Cap 311).	۸
	Office waste can be reduced through recycling of paper if volumes are large enough to warrant collection.	٨
	Good management practices should be implemented to ensure that refuse is properly stored and is transported for disposal of at licensed landfills.	٨

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

[#] Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Terrestrial Ecology	During the detailed design stage, the following issues should also be considered as possible to further minimise the impacts: • Adjustment of site boundary to minimise temporary loss of natural stream habitat during construction. • Adjustment of site boundary to minimise use of mixed woodland as temporary works area. In particular, the woodland habitat in temporary works area of the Eastern Portal will be avoided, thereby greatly reducing the area of temporary loss of woodland habitat. • Minimizing felling of large trees. • About 20% of trees within the works area will be transplanted. The individual of Artocarpus hypargyreus recorded within the temporary works area of HKU1, if to be encroached, would also be transplanted. Standard site practices including the following, should be enforced to minimise the disturbance to the surroundings: • Treat any damage that may occur to large individual trees in the adjacent area using materials and methods appropriate for tree surgery. • Reinstate work sites/disturbed areas immediately after completion of the construction works, in particular, through on-site tree/shrub planting along the woodland and shrubland section within the temporary works area. Tree/shrub species used should make reference from those in the surrounding area. • Regularly check the work site boundaries to ensure that they are not exceeded and that no damage occurs to surrounding areas. A total of 1.02 ha would be replanted with woodland species, reaching almost a 1.5:1 ratio for compensatory planting. Tree/shrub species used should be based on those in the surrounding areas, including those which are commonly recorded during the baseline surveys.	^ ^ ^
	A low-flow channel would be provided within the channelised section to maintain a deeper water depth in the expanded channel, in particular during dry season as well as a basin at the end of the channelised section to provide living space for aquatic life. Step chute in the form of a series of descending water pools would be constructed between the low flow channel and the undisturbed stream course. There would also be openings for aquatic fauna between each chute step (pool). These could work like a "ladder" to help avoid isolating the aquatic fauna in the channelised section from natural habitats.	۸
	Measures are also needed to maintain the flow of all affected streams/nullahs during the construction stages. Temporary bypass should be provided if the stream/nullah flows will be cut off by the construction works. After the construction works are finished, sections of temporary loss should be reinstated. Construction materials, wastes, and equipment should be cleared from the sites.	^

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	Surveys of amphibians at E4(P), PFLR1(P), W12(P), MB16, E5(B)(P), TP789(P) and P5(P) prior to commencement of construction is recommended. Frogs, including Hong Kong Cascade Frog and Lesser Spiny Frog, and tadpoles found at work areas of these proposed intake points will be collected and translocated to nearby streams that will not be affected by the project. These procedures should be performed by experienced herpetologists. A detailed translocation proposal will be submitted during the detailed design stage.	۸
	Measures should also be taken to avoid runoff to streams and marine habitats. Stream/channel which could potentially be affected during construction should be prevented from sedimentation by erection of sediment barriers. Site runoff should be desilted by siltation traps in streams/channels or diverted, to reduce the potential for suspended sediments, organics and other contaminants to enter the local stream environment.	۸
Marine Ecology	Silt curtains will be deployed during the construction and demolition of the temporary berthing point. Deployment of silt curtains around the berthing point area would effectively avoid adverse water quality impacts due to barge filling. No significant ecological impact is anticipated.	N/A
	The invert of the stilling basin would be at -5.4 mPD. A cofferdam in the form of pipe-pile wall is to be constructed outside the stilling basin prior to the construction of basin. The cofferdam will be dewatered to provide a working area for construction of the stilling basin. The boulders from the seawall will then be removed by landbased grabs.	۸
	Although the speed of the working vessels to be used in the Project (mainly barges) would not be high, a speed limit for marine traffic is proposed as a precautionary measure. A speed limit of 10 knots should be strictly enforced in the works area, in particular in the waters between the outfall location and the navigation channel in East Lamma Channel.	٨

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Impacts Landscape and Visual	The proposed landscape and visual mitigation measures during the construction phase include: CM1 - Topsoil, where identified, should be stripped and stored for re-use in the construction of the soft landscape works, where practical. CM2 - Existing trees to be retained on site should be carefully protected during construction. The detailed proposal for any trees felling and transplantation is subject to Lands Department's approval on tree felling application at the detailed design stage. CM3 - Trees unavoidably affected by the works should be transplanted where practical. CM4 - Compensatory tree planting should be provided to compensate for felled trees. CM5 - The extent of disturbance on the existing stream course should be minimized. Any temporary works areas within the stream course shall be reinstated after construction. CM7 - Control of night-time lighting CM8 - Erection of decorative screen hoarding	^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^ ^

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Impacts	The Cultural Heritage Impact Assessment has identified the following resources which will require mitigation measures during the construction stage; Haw Par Mansion (including boundary wall and gate) A condition survey must be undertaken by a qualified professional prior to the commencement of construction works for the tunnel portal in order to assess the structural integrity of the mansion, wall and gate (with special attention paid to any fragile architectural features). A report containing description of the types of construction, identification of fragile elements, an appraisal of the condition and a photographic record must be prepared. The report must also provide an assessment indicating whether further precautionary measures will be necessary during the construction phase, and if so provide details for sufficient protective measures, including monitoring for vibration control to ensure that no damage to the structure and fabric of the house, wall and gate results from the	٨
Cultural Heritage	Inomtoring for vibration control to ensure that no damage to the structure and fabric of the nouse, want and gate results from the construction works. The report must be submitted to AMO for approval before construction activities commence. Upon approval the appropriate monitoring and precautionary measures shall be put into place. A buffer zone with a minimum width of 3 metres and an obstruction free access point must be maintained between the boundary wall/gate and the temporary works area (during construction works associated for both the tunnel portal and the permanent vehicle access ramp). This is to enable access for routine maintenance works on the wall and to ensure that the wall is not damaged by machinery operation or related construction activities. The temporary works area will be enclosed by standard DSD site hoarding.	٨
	Former Explosive Magazine of Victoria Barracks	
	A condition survey must be undertaken by a qualified professional prior to the commencement of construction works in order to assess the structural integrity of the retaining wall and the extent of damage from cracks and vegetation growth. A report containing a description of the wall's construction materials, identification of fragile and/or endangered elements, an appraisal of the condition and a photographic record of the retaining wall must be prepared. The report must also provide an assessment indicating whether further precautionary measures will be necessary during the construction phase, and if so provide details for sufficient protective measures, such as monitoring for vibration control, to ensure that no damage to the retaining wall results from the construction works. The report must be submitted to AMO for approval before construction activities commence. Upon approval the appropriate monitoring and precautionary measures shall be put into place.	٨
	A buffer zone with a minimum width of 3 metres and an obstruction free access point must be maintained between the retaining wall and the temporary works area (for the duration of the construction phase). The works area will be enclosed by standard DSD site hoarding.	۸

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Fisheries	Silt curtain will be deployed during the construction and demolition of the temporary berthing point. With the deployment of silt curtains around the berthing point area, adverse water quality impact associated with the filling would not be anticipated. No significant fisheries impact is anticipated.	N/A
	The invert of stilling basin will be found at -5.4 mPD. A cofferdam in the form of pipe-pipe wall is to be constructed outside the stilling basin prior to the construction of basin. The cofferdam will be dewatered to provide a working space for the construction of stilling basin. The boulders from the seawall will then be removed by landbased grabs.	۸
Hazard to Life	There will be no overnight storage of explosives for this project. Transportation of explosives to site for the construction of adit will be undertaken on a daily basis. The contractor is required to destroy any unused explosives before nightfall. If contractor wishes to set up magazines for overnight storage of explosives, it is necessary to carry out risk assessment and seek the relevant approval following the EIAO process.	۸

N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;

* Recommendation was made during site audit but improved/rectified by the contractor;

* Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

APPENDIX K EVENT ACTION PLANS

Appendix K - Event Action Plans

Event/Action Plan for Air Quality

	ACTION						
EVENT	ET	IEC	SUPERVISING OFFICER'S REPRESENTATIVE	CONTRACTOR			
ACTION LEVEL							
1.Exceedance for one sample	 Identify the source and investigate the causes and propose remedial measures Inform Supervising Officer's Representative & IEC Repeat measurement to confirm finding Increase monitoring frequency to daily 	Check monitoring data submitted by ET Check Contractor's working methods	1.Notify Contractor	1.Rectify any unacceptable practice 2.Amend working methods if appropriate			
2.Exceedance for two or more consecutive samples	1. Identify the source 2. Inform Supervising Officer's Representative & IEC 3. Repeat measurements to confirm findings 4. Increase monitoring frequency to daily 5. Discuss with Supervising Officer's Representative & IEC for remedial actions required 6. If exceedance continues, arrange meeting with Supervising Officer's Representative & IEC 7. If exceedance stops, cease additional monitoring	1.Checking monitoring data submitted by ET 2. Check Contractor's working methods 3. Discuss with ET, IEC and Contractor on proposed remedial actions 4. Advise the Supervising Officer's Representative & ET on the effectiveness of the proposed remedial measures 5.Supervise the implementation of the remedial measures	1.Confirm receipt of notification of failure in writing 2.Notify Contractor 3.Ensure remedial actions properly implemented	1.Submit proposals for remedial actions to Supervising Officer's Representative within 3 working days of notification 2.Implement the agreed proposals 3.Amend proposal if appropriate			
LIMIT LEVEL							
1.Exceedance for one sample	I. Identify source,,investigate the causes and propose remedial measures Inform Supervising Officer's Representative & IEC and EPD Repeat measurement to confirm finding Increase monitoring frequency to daily Assess effectiveness of Contractor's remedial actions and keep EPD and Supervising Officer's Representative & IEC informed of the results	 Check monitoring data submitted by ET Check Contractor's working methods Discuss with ET and Contractor on proposed remedial actions Advise the Supervising Officer's Representative on the effectiveness of the proposed remedial measures Supervise the implementation of the remedial measures 	1.Confirm receipt of notification of failure in writing 2.Notify Contractor 3.Ensure remedial actions properly implemented	1.Take immediate action to avoid further exceedance 2.Submit proposals for remedial actions to Supervising Officer's Representative within 3 working days of notification 3.Implement the agreed proposals 4.Amend proposal if appropriate			
2.Exceedance for two or more consecutive samples	I. Identify source Inform Supervising Officer's Representative, IEC and EPD the causes & actions taken for the exceedances Repeat measurement to confirm findings	1.Discuss amongst Supervising Officer's Representative, ET and Contractor on the potential remedial actions 2.Review Contractor's remedial actions to assure their effectiveness and advise the	1.Confirm receipt of notification of failure in writing 2.Notify Contractor 3.In consultation with the IEC, agree with the Contractor on the remedial measures to be	1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to Supervising Officer's Representative within 3 working			

		ACTION						
EVENT	ET	IEC	SUPERVISING OFFICER'S	CONTRACTOR				
			REPRESENTATIVE					
ACTION LEVEL								
	4. Increase monitoring frequency to daily 5. Investigate the causes of exceedance 6. Arrange meeting with & IEC and Supervising Officer's Representative to discuss the remedial actions to be taken 7. Assess effectiveness of Contractor's remedial actions and keep ER, IEC and EPD informed of the results 8. If exceedance stops, cease additional monitoring	Supervising Officer's Representative accordingly 3. Supervise the implementation of the remedial measures	implemented 4.Ensure remedial measure are properly implemented 5.If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated	days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated				

Event/Action Plan for Construction Noise

EVENT		ACT	ION	
	ET	IEC	SUPERVISING OFFICER'S REPRESENTATIVE	Contractor
Action Level	Notify IEC, Supervising Officer's Representative and Contractor carry our investigation by reviewing all the relevant monitoring data and the corresponding construction activities. Exceedances should also be confirmed by immediate verification in the field as far as practical. Report the results of investigation to the IEC, Supervising Officer's Representative and Contractor Discuss with the Contractor and formulate remedial measures increase monitoring frequency to check mitigation effectiveness	1.Review the analysed results submitted by the ET 2. Review the proposed remedial measures by the Contractor and advise the Supervising Officer's Representative & ET accordingly 3.Supervise the implementation of remedial measures	Confirm receipt of notification of complaint in writing Notify Contractor require Contractor to proposed remedial measures for analyzed noise problem Ensure remedial measures are properly implemented	I. Identify practicable measures to minimize the noise impact. Submit noise mitigation proposals to ET, IEC and ET. Implement noise mitigation proposals
Limit Level	 Notify IEC, Supervising Officer's Representative, EPD and Contractor Identify the source(s) of impact by reviewing all the relevant monitoring data and the corresponding construction activities. Exceedances should also be confirmed by immediate verification in the field as far as practical. Repeat measurement to confirm findings Increase monitoring frequency Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. inform IEC, Supervising Officer's Representative and EPD the cause & actions taken for the exceedances Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and Supervising Officer's Representative informed of the results If exceedance stops, cease additional monitoring. 	Discuss amongst Supervising Officer's Representative, ET, and Contractor on the potential remedial actions Review Contractor's remedial actions to assure their effectiveness and advise the Supervising Officer's Representative &ET accordingly Supervise the implementation of the remedial measures	Confirm receipt of notification of exceedance in writing Notify Contractor Require Contractor to propose remedial measures for the analyzed noise problem Ensure remedial measures are properly implemented If exceedance continuous, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is aborted	Take immediate action to avoid further exceedance Identify practicable measures to minimize the noise impact. Submit proposals for remedial actions to Supervising Officer's Representative within three working days of notification Implement the agreed proposals Resubmit proposal if problem still not under control Stop the relevant portion of works as determined by the Supervising Officer's Representative until the exceedance is abated

Event/Action Plan for Water Quality

		AC	CTION	
EVENT	ET	IEC	SUPERVISING OFFICER'S REPRESENTATIVE	CONTRACTOR
ACTION LEVEL				
Action level being exceeded by one sampling day	Repeat in situ measurement to confirm findings; Identify source(s) of impact; Inform IEC, contractor and Supervising Officer's Representative; Check monitoring data, all plant, equipment and Contractor's working methods. Discuss mitigation measures with IEC and Contractor Repeat measurement on next day of exceedance.	Discuss with ET and Contractor on the mitigation measures. Review proposals on mitigation measures submitted by Contractor and advise the Supervising Officer's Representative accordingly; and Assess the effectiveness of the implemented mitigation measures.	Discuss with IEC on the proposed mitigation measures; and Make agreement on the mitigation measures to be implemented.	1. Inform the Supervising Officer's Representative and confirm notification of the non-compliance in writing; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Discuss with ET and IEC and propose mitigation measures to IEC and Supervising Officer's Representative; 6. Implement the agreed mitigation measures.
Action level being exceeded by more than one consecutive sampling days	1. Repeat in-situ measurement to confirm findings; 2. Identify source(s) of impact; 3. Inform IEC, contractor; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Supervising Officer's Representative and Contractor; 6. Ensure mitigation measures are implemented; 7. Prepare to increase the monitoring frequency to daily; 8. Repeat measurement on next day of exceedance.	Discuss with ET and Contractor on the mitigation measures. Review proposals on mitigation measures submitted by Contractor and advise the Supervising Officer's Representative accordingly; and Assess the effectiveness of the implemented mitigation measures.	Discuss with IEC on the proposed mitigation measures; and Make agreement on the mitigation measures to be implemented. Assess the effectiveness of the implemented mitigation measures.	Inform the Supervising Officer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and Supervising Officer's Representative within 3 working days; Implement the agreed mitigation measures.
LIMIT LEVEL				
Limit level being exceeded by one sampling day	1. Repeat measurement on next of exceedance to confirm findings; 2. Identify source(s) of impact; 3. Inform IEC, contractor, Supervising Officer's Representative and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Supervising Officer's Representative and Contractor.	 Check monitoring data submitted by ET and Contractor's working methods. Discuss with ET and Contractor on possible mitigation measures; Review the proposed mitigation measures submitted by Contractor and advise the Supervising Officer's Representative accordingly; 	 Confirm receipt of notification of failure in writing Discuss with IEC, ET and Contractor on the proposed mitigation. Request Contractor to view the working methods. Ensure mitigation measures are properly implemented. 	 Inform the Supervising Officer's Representative and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Discuss with ET, IEC and Supervising Officer's Representative and propose mitigation measures to Supervising Officer's Representative and IEC within 3 working days;

		AC	CTION	
EVENT	ET	IEC	SUPERVISING OFFICER'S REPRESENTATIVE	CONTRACTOR
				5. Implement the agreed mitigation measures.
Limit level being exceeded by more than one consecutive sampling days	1. Repeat measurement on next of exceedance to confirm findings; 2. Identify source(s) of impact; 3. Inform IEC, contractor, Supervising Officer's Representative and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Supervising Officer's Representative and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days.	 Check monitoring data submitted by ET and Contractor's working methods. Discuss with ET and Contractor on possible mitigation measures; Review the proposed mitigation measures submitted by Contractor and advise the Supervising Officer's Representative accordingly; Supervise the implementation of mitigation measures. 	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Ensure mitigation measures are properly implemented; Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level	1. Take immediate action to avoid further exceedance 2. Discuss with ET, IEC and Supervising Officer's Representative and propose mitigation measures to Supervising Officer's Representative and IEC within 3 working days; 3. Implement the agreed mitigation measures; 4. Resubmit proposals of mitigation measures if problem still not under control; 5. As directed by the Supervising Officer, to slow down or to stop all or part of the construction activities until no exceedance of Limit level.

APPENDIX L COMPLAINT LOG

APPENDIX L - COMPLAINT LOG

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
Com-2008-05-003	Construction site at Eastern Portal	22 May 2008	The complaint was lodged by Ms. Ng on 22 May 2008 regarding noise nuisance generated from the construction activities at the construction site of Eastern Portal	According to the Contractor, only one excavator and one generator were operated for the excavation works around 8 am on 22 May 2008 at the Eastern portal. No other construction activities were conducted. In response to the complaint, The Contractor agreed to reschedule their current works activities, with immediate effect from 23 May 2008, that only site preparation works without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at the Eastern Portal area. Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in May and (2) no noncompliance or observation on noise was recorded.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
Com-2008-05-004	Construction site at Western Portal (Marine Works)	31 May 2008	The complaint was lodged by one of the local resident on 31 May 2008 regarding the noise nuisance generated from the marine works at Western Portal.	According to the Contractor, only two derrick barges and one tug boat were operated for the seabed formation works around 18:00 hrs on 31 May 2008 at the Western Portal. No other construction activities were conducted. Base on the information collected	Closed
Com-2008-07-007	Construction site at Eastern Portal	2 July 2008	The complaint was lodged by a resident of The Legend on 2 July 2008 regarding noise nuisance generated from the construction activities at the construction site of Eastern Portal	preparation works around 7:30a.m on 2 July 2008 at the Eastern portal. Construction noise was found from	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				In response to the complaint, The Contractor review his forthcoming operations within the Eastern Portal site as previous they agreed, reschedule their current works activities, with immediate effect from 23 May 2008, that only site preparation works without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at the Eastern Portal area. Additional noise monitoring was conducted on 16 and 17 July 2008 during the drilling rig (Jumbo), excavator and wheel loader were operated for drilling works.	
				Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in June and July 2008 and additional noise monitoring (2) no non-compliance or observation on noise was recorded.	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2008-10-011	Construction site at Western Portal	11 October 2008	The complaint was lodged by one of the resident of Victoria Road, Ms Cheung on 11 October regarding about the noise nuisance generated from the construction works at Western Portal	According to the Contractor,	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
Dog Rei	Document	Received Bute	Details of Complaint	noise limit of 75 dB(A). Also, the Contractor has implemented the remedial measure that reschedule the starting time of the construction works to 8:15am on every Saturday immediately after receiving the complaint to minimize the noise	Status
COM-2008-10-012	Construction site at Intake TP5	15 October 2008	The complaint was lodged by Mr Choi on 15 October 2008 regarding about the noise generated from the GI works, which starts from 8:30 hrs to 17:30 hrs next to Aigburth at May Road.	provided by the Contractor, only rotary type drill rigs and water pumps were operated for the GI works at the time of complaint at	Closed
COM-2008-10-013	Construction site at Intake TP5	31 October 2008	The complaint was lodged by Mr Lai on 31 October 2008 regarding the black smoke is emitted and noise is generated from the machine at the site (Intake TP5), he needed to close the windows to prevent the black smoke from entering his flat and to attenuate the noise.	Additional site inspection and noise monitoring at the podium of the Valverde at May Road were conducted on 3 Nov 2008 and 24 Oct, 5 Nov, 7 Nov 2008 respectively. The Contractor agreed to reschedule the starting time of the construction works to 9:30am on every Saturday and 8:00 on normal weekdays that	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2008-11-015	Construction site at Intake TP5	4 November 2008	The complaint was lodged by Ms Lee on 4 November regarding the noise nuisance generated from the construction works at Intake TP5.	without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at Intake TP5. Acoustic insulating materials have been applied for enclosing water pump and rotary type drill rigs to minimize the noise nuisance to the nearest residents. Base on the information collected, the noise level measured at the podium of the Valverde at May Road were well below the construction noise limit of 75 dB(A) after the Contractor has implemented the remedial measure.	
COM-2008-11-016	Construction site at Western Portal	17 November 2008	The complaint was lodged by Mr Cheng on 17 November 2008 regarding dust nuisance arising from the soil nailing works at the roadside slope of Cyberport Road.	According to the information provided by the Contractor, soil nailing works were conducted and some plant equipments i.e air compressor and generator were operated at the time of complaint at Western Portal. Base on the regular air quality monitoring in November 2008 at Outside Aegean Terrace (AQ2) and Outside The Site Office at Western	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				Portal (AQ3), the dust levels measured at AQ2 for 1 hour TSP and at AQ3 for 24 hour TSP were well below the Action Level (321µg/m3 for 1 hour TSP and 156µg/m3 for 24 hour TSP). Also, the Contractor has implemented the dust suppression measures to prevent dust nuisance from the construction activities including soil nailing works.	
COM-2008-11-019	Construction site at Western Portal	29 November 2008	The complaint was lodged by Ms Cheung on 1 December 2008 regarding noise nuisance at Western Portal at 08:30 hrs approx on 29 November 2008 and 00:30 on 1 December 2008.	the temporary jetty at the time of complaint (00:30 on 1 December 2008) at Western Portal.	Closed
	Construction site at Western Portal			The complaint was considered not justifiable as Construction Noise Permit (CNP) – CNP No. GW-RS0827-08 has been granted from	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2008-12-020		28 December 2008	The complaint was lodged by Ms Cheung on 28 December 2008 regarding the excavator was found working within Western Portal works area on Sunday.	EPD for carrying out the construction works at Hong Kong West Drainage Tunnel (Western Portal), Cyberport Road, Cyberport,	
COM-2009-01-021	Muddy Water Discharged into Sea at Western Portal	21 January 2009	Muddy water was observed from discharging into the sea at Western Portal Site	Base on the information collected, the muddy water discharged into the sea is considered due to the operations of excavation of stilling basin and poor condition of the silt curtain. The Contractor agreed to review their current provisions to prevent any muddy water from discharging into the sea again and close check the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				condition of the silt curtain.	
COM-2009-01-022(A) COM-2009-01-022(B)	Construction site at Western Portal	12 January 2009 21 January 2009	The complaint was lodged by Mr Chan, the assistant of Mr CHAN Ngok pang (Southern District Councillor) about the resident in Baguio Villa near Victoria Road, Mr Ronald Chan concerns on the noisy activities carried out at Western Portal site. The complaint was lodged by resident of Aegean Terrace at Sassoon Road about the noise nuisance generated from	the noise level measured at outside Aegean Terrace during the construction works at Western Portal site were well below the construction noise limit of 75 dB(A). Aegean Terrace is at location close to the major site activities compared with Baguio Vila. Also, The Contractor	Closed
COM-2009-01-022(C)		21 January 2009	Western Portal Site. The complaint was lodged by the resident in Baguio Villa near Victoria Road about noisy works at Western Portal Site.	works activities, no noisy work will be carried out at Western Portal Site	
	Construction site at Eastern Portal		Complaint of Construction	Based on the information collected, the construction noise at about 07:45hrs on 7 February 2009 was due to the checking of the backhole by the sub-contractor.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2009-02-023		7 February 2009	(07:45hrs) at Eastern Portal Site	The Contractor was reminded to strengthen their site supervision and provide sufficient site-specific environmental training for subcontractor to ensure that such situation would not be recurred.	
COM-2009-03-025	Construction site at Western Portal	2 March 2009 4 March 2009 7 March 2009	Complaint of noise generated by midnight works and night-time lighting at Western Portal Site Complaint of pipe hitting noise at midnight at Western Portal Site.	the regular noise monitoring was conducted during the construction works at the restricted hours. The noise measurement results were well below the construction noise limit of	
				The Contractor was reminded to strengthen their site supervision and implement necessary noise mitigation measures to minimize and avoid the construction noise impact to the residents nearby especially during the restricted hours. Regarding the complaint of spotlight hanging on the plant at the site portion WP, The Contractor was	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				reminded to implement the	
				mitigation measures for Visual	
				during the construction by	
				controlling the night-time lighting so	
				that the residual visual impacts can	
				be accepted.	
COM-2009-04-028	Construction	7 April 2009	Complaint of noise generated		
	site at Western		from the construction works	/ /	
	Portal		conducted till 11:00pm at		
			Western Portal of the Hong	7 1	
G011 4000 04 040		10 1 11 2000	Kong West Drainage Tunnel.	operated for the construction works	
COM-2009-04-029		10 April 2009	Complaint of noise generated		
			by TBM works at Western		
			Portal.	belt and ventilation fan were	
				operated on 10 April 09 (Sunday). No operation of derrick barge on 10	
				April 09.	
				April 07.	Closed
				According to the photos taken on 8	Closed
				April 2009, misplacement of plant	
				was observed at Western Portal Site.	
				Upon advice, The Contractor	
				immediately moved the fan properly.	
				Based on the information collected,	
				the construction noise levels	
				measured were well below the	
				construction noise limit of 75 dB(A)	
				for the period of 0700-1900 hrs on	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				normal weekdays, 65 dB(A) for the	
				period of 0700-2300 hrs on holiday;	
				and 1900-2300 hrs on all other days	
				and baseline level for the period of	
				2300-0700 hrs of next day. The	
				ground borne noise levels measured	
				were also well below the	
				construction ground borne noise	
				standards (i.e. 65 dB(A) – Daytime	
				(except General Holiday and	
				Sundays) and 55 dB(A) – Daytime	
				during general holidays and Sunday	
				and all days during Evening (1900 to	
				2300 hrs). No exceedances of noise	
				level have been recorded in March	
				and April 2009.	
				The Contractor was advised to	
				strictly follow the conditions of the	
				permit to avoid any misplacement of	
				plants in the future. Also, The	
				Contractor should take sufficient	
				noise mitigation measures to	
				minimize the environmental impact	
				on the nearby community as	
				recommended in the approved EIA	
				report.	
				In addition, DNJV already arranged	
				tailors made training for the	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				Production Team including the senior management and foreman to explain the conditions and requirements listed on the CNP and delegated one Engineer to ensure all construction activities and PMEs to be used are fully complying with CNP and legislation requirements before the commencement of the construction activities during the restricted hour.	
				Base on the information collected, regular noise Monitoring was conducted during the night time to check the noise levels are complying with the construction noise criteria. The noise levels measured at NC3 during the construction works at night time were well below the construction noise limit.	
				The Contractor was reminded to strengthen their site supervision by delegated Engineer to ensure all construction activities and PMEs to be used are fully complying with CNP and legislation requirements and implement necessary noise	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				mitigation measures as recommended in the Approved EIA report to minimize and avoid the construction noise impact to the residents nearby especially during the restricted hours.	
COM-2009-04-030	Construction site at Western	30 April 2009	Complaint of Construction Noise Generated at Night at Western Portal.	According to the site activities diaries, TBM chainage, TBM excavation, installation of segment ring, pea gravel & mortar injection and installation cables & pipes at	
COM-2009-05-031	Portal	4 May 2009	Complaint of low frequency noise emitted from the construction site at Western Portal.	gantries were the activities conducted in the night of 30 April 2009. In accordance with the night time	
	11 1	11 May 2009	Complaint of Construction Noise nuisance generated from the Western Portal Site from day to night.	visit on 15 May 2009, the noise levels at Aegean Terrace was not high but with occasionally sound of locomotive and tower crane operations.	Closed
				No exceedance of noise level was recorded since the commencement of the project works at Western Portal Site. The noise levels measured at NC3 during the construction works were well below the construction noise limit.	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				The Contractor will continue implementing their mitigation measures (e.g. Instruct workers not to shout during work in the evening; no horn signal of locomotive after 6:55 pm).	
COM-2009-05-032	Construction site at Eastern Portal	13 May 2009	The complaint was lodged by a resident regarding the Construction Noise Nuisance from the construction works that were carried out from early morning till night time at Eastern Portal Site Area.	Based on the information collected, the noise levels measured at NC1/NC1a and NC2 during the construction works were well below the construction noise limit or baseline level. The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents especially during the restricted hours.	Closed
COM-2009-06-035	Hong Kong West Drainage Tunnel Construction Site at Cyberport	3 June 2009	EPD received a public complaint raised by Mr. Lee regarding the transportation and disposal of construction wastes from Hong Kong West Drainage Tunnel Construction Site at Cyberport on 3 June 2009.	have been submitted the relevant information and sought the approval	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				ground.	
COM-2009-06-037	Construction site at Eastern Portal	23 June 2009	The few noise complaints were lodged by a resident of The Legend and Ronsdale Garden regarding the Construction Noise Nuisance from the construction works at Eastern Portal Site Area since 7:00a.m and in the afternoon. The complaint was raised by Ms Wong of Goodwell Property Management, she wrote on behalf of the Estate Owner Committe of Legend at Tai Hang about noise nuisance arising from the excacvation works at Eastern Portal site portion. The Committe requested the Contractor to provide mitigation measures to mininise the impact.	Based on the information collected, the noise levels measured at NC1 and NC2 during the construction works were well below the construction noise limit or baseline level. In response to the complaints, the head of hydraulic breaker has been wrapped with sound proof materials and movable noise barriers were provided for rock excavation to reduce noise. The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2009-08-040	Construction site at Intake PFLR1	26 August 2009	The complaint was relating to the noise generated from the construction activities of breaking of the existing boundary wall of Pokfulam Road Playground by use of the hand-held electric breaker.	Noise monitoring results conducted on 1 September 2009 at NC11 - Honey Court for the Intake PFLR1 was submitted and no exceedance was recorded. In addition, based on the regular site inspection conducted	Closed
COM-2009-09-042	Construction site at Eastern Portal	21 September 2009	The complaint was raised by a resident of The Legend regarding poor housekeeping and construction noise nuisance from the Eastern Portal Site Area.	taken action immediately to rectify the complaint of poor housekeeping.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
Log Ref.	Location	Received Date	Details of Complaint	temporary works were stored in an orderly manner. Regarding the complaint of construction noise impact, the noise levels measured at The Legend (NC2) during the construction works in the normal working hours were well below the construction noise limit level. Nevertheless, the Contractor is also	Status
				committed to implementing sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents and provide training for the workers to increase awareness of their environmental responsibilities.	
COM-2009-10-044	Construction site at Eastern Portal	6 and 7 October 2009	The complaint was raised by a resident of The Legend and Ronsdale Garden regarding the construction noise	the Investigation, the noise levels measured (additional noise	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2009-10-045			nuisance from the Eastern Portal Site Area.		
COM-2009-11-054	Construction site at Western Portal	23 and 29 November 2009	The complaint was raised by a resident of Aegean Terrace regarding the construction noise nuisance from the	Base on the information collected, the noise levels measured at NC3 during the construction works were well below the construction noise	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			Western Portal Site Area.	limit. Nevertheless, the Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report, Clause 5.4.15 to minimize/avoid the nuisance caused to the nearby residents.	
COM-2009-12-059	Construction site at Intake MB16	27 November 2009	The complaint was received on 2 November 2009 regarding the dust nuisance caused by the works at the Construction Site at Mount Butler Road near Clementi Road (Intake MB16). EPD subsequently issued a notice of complaint.	the Contractor has implemented the dust suppression measures to prevent dust nuisance from the construction activities. During the site inspection in	Closed
COM-2009-12-061	Construction site at Intake PFLR1	23 and 28 December 2009	Two public complaints were received from the resident of Pok Fu Lam Road on 23rd and 28th December 2009 respectively about the construction noise nuisance from the construction site at	the Investigation, the noise levels measured at Honey Court (NC11)	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
C			Intake PFLR 1.	The location of the designated noise monitoring station (NC11 – Honey Court) is at location close to the construction site compared with Pok Fu Lam Height. In addition, a large scale innovation works being undertaken at a resident building adjacent to the Pok Fu Lam Height was observed during the routine site inspection. The	
GOM 2010 01 072		2010		innovation works included hammering and drilling on the outer walls of the building and contributed significantly to the noisy environment.	
COM-2010-01-062	Construction site at Western Portal	3 January 2010	The public complaint was received from the resident of Bel-Air through the project hotline on 3rd January 2010 about "wooing" sound heard after midnight, and he suspected that the sound was coming the construction sites at Cyberport.	the noise levels measured at NC3 during the construction works were well below the baseline level. The location of the designated noise monitoring station (NC3 – Outside Aegean Terrace) is at location close	Closed
				The Contractor will continue implementing the existing noise mitigation measures at the Western Portal to minimize the	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-01-063 COM-2010-01-066(1), (2) and (3)	Intake MB16	Received Date 20 January 2010 23, 25, 27 January and 2 February 2010	The first complaint was raised by the resident at No. 58 Mount Butler Road about the noise and vibration	environmental impact to the nearby residents. Based on the EIA assessment results, No. 58 Mount Butler Road and Amber Lodge are not the potential ground borne noise sensitive receivers as they are not within the influence zone near the Main Tunnel alignments from Cyberport to Tai Hang and the alignments of the adits.	Status
			Hotline regarding the low	levels measured at inside Amber Lodge during the TBM works were	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-02-073	Western Portal	3 February 2010	Complaint of noise generated by the operation of plants, rock falling and flash lighting within Western Portal site area.	the noise levels measured at NC3 during the construction works were	Closed
COM-2010-03-080	Intake PFLR1	1 March 2010	The public complaint was received from the resident of Honey Court referred by a DC member (Mr. Stephen Chan) on 1st March 2010 about the construction noise nuisance from the construction site at Intake PFLR 1	Based on the information gathered in the Investigation, the noise levels measured at Honey Court (NC11) in February and March 2010 were ranged from 62.3 dB(A) to 74.7 dB(A). The noise levels were marginally below the 75dB (A) limit	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-03-081	Intake TP789	5 March 2010	The complaint was received from Kerry Management Ltd. on 5th March 2010 about the construction noise complaints raised by some tenants of Tavistock. They complained about the noisy activities being carried out at Intake TP789 on Saturday.	the investigation, the noise levels measured at Tregunter Path near Tavistock were below the construction noise limit and the Contractor has already implemented the noise mitigation measures to	Closed
COM-2010-03-082 and COM-2010-03-087	Western Portal	6 March 2010 15 March 2010	Two public complaints were received from the residents of Bel-Air at Western Portal on 6th and 15th March 2010 about the Construction Noise and Dust Nuisance from Hong Kong West Drainage Tunnel Construction Site at Cyberport (i.e. Western Portal Site) respectively.	measured at NC3 and AQ2/AQ3 during the construction works were below the noise and air quality criteria respectively. Also, the Contractor has implemented appropriate environmental mitigation	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				from the construction works. Nevertheless, the Contractor was reminded to review the effectiveness of the implemented noise and air quality mitigation measures from time to time during different construction phases.	
COM-2010-04-094	Western Portal	9 April 2010	The public complaint was received by EPD hotline on 9th April 2010 regarding construction dust nuisance from the Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site)	AQ2 and AQ3 during the construction works were below the air quality criteria. Also, the Contractor has implemented	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				enough and appropriate to suit the site condition from time to time during different construction phases to minimize the dust nuisance.	
COM-2010-04-097	Intake TP789/TP4	22 April 2010	The complaint was received from resident of Tregunter Tower on 22 nd April 2010 about the noisy activities being carried out at Intake TP789/TP4 in the morning.	the investigation, the noise levels measured at Tregunter Path near Tavistock were below the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-04-100	Western Portal	30 April 2010	The public complaint was received from the resident of Bel-Air on 30 th April 2010 regarding the dust nuisance generated during loading / unloading operation from two barges at pier of Cyberport. Dark smoke was also emitted from the two barges.	Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria. The Contractor has taken initiative to	Closed
COM-2010-05-105	Western Portal	7 May 2010	The second complaint was received via EPD Hotline on 7 May 2010. The anonymous complainant concerned about the dark smoke emitted from the barges on 4 May 2010	Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			and many dump trucks parking outside the Western Portal Site on 5, 6 and 7 May 2010.	Although the air quality levels measured at AQ2 and AQ3 were below the air quality criteria, we advised the Contractor to	
COM-2010-05-105 (2)		17 May 2010	The complaint was received via EPD Hotline on 17 May 2010. The anonymous complainant complaint about the open stockpile of dusty materials without covered entirely.	mitigation measures and review the existing measures if such measures are	
				Nevertheless, the Contractor is also committed to take sufficient dust mitigation measures as recommended in the approved EIA report including installation of 3-sided curtain-like enclosure at the conveyor discharge point to the barge to minimize the dust nuisance on the nearby residents.	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-06-113	Intake PFLR1	2 June 2010	The complaint was received by DSD on 2 June 2010 regarding siren sound was generated from the site throughout the day which caused nuisance.	The noise source was generated from the alert system of the backhoe during operation. The backhoe was	Closed
	Western Portal	15 June 2010		the air quality levels measured at AQ2 and AQ3 during the construction works were below the Action Level (321µg/m3 for 1 hour TSP and 156µg/m3 for 24 hour TSP). Also, the Contractor has	Closed
COM-2010-07-121	Western Portal	15 July 2010	Cyberport Management Office lodged a complaint in writing regarding the sands and mud left by the dump trucks on Cyberport road	to Cyberport Management Office on 26 July 2010 stating the following:-	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				powder in trucks. The trucks have been equipped with tailor-made tanks to receive the liquid of granite powder. To prevent reoccurrence, DNJV will reinforce checking of these tanks and other truck conditions at work site to ensure no dripping before departure. In this regard, the Contractor was reminded that all vehicles and plant should be cleaned before leaving the construction site to ensure no earth, mud and debris or other wastes is deposited on roads. Proper maintenance of the tailor-made tanks equipped at the trucks is also needed to avoid any leakage.	
COM-2010-07-123 (1)	Eastern Portal	2 August 2010	The complaint was received through the Project Hotline regarding the noise generated from construction vehicles.	Based on the information collected, the noise levels measured at NC1/NC1a and NC2 during the construction works were well below	
COM-2010-07-123 (2)		2 August 2010	The complaint was received by DSD concerning the noise generated from construction site at 19:00.		Closed
COM-2010-08-125		3 August 2010	The complaint was received by DSD concerning the noise	implement sufficient noise mitigation	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			generated from construction site until 8:00 pm every night.	approved EIA report to minimize the nuisance caused to the nearby residents especially during the restricted hours.	
COM-2010-08-124	Intake TP789/TP4	2 August 2010	The complaint was received by DSD regarding the construction works at Tregunter Path is extremely noisy and diminishes the ability of residents of the neighborhood to enjoy outdoor facilities	the investigation, the noise levels at Tregunter Tower was within the construction noise limit of 75dB(A). The Contractor has taken initiative to minimize noise nuisance to the	Closed
COM-2010-08-124 (con'd)		5 August 2010	The complaint was received by DSD regarding the construction works at Tregunter Path is extremely noisy and diminishes the ability of residents of the neighborhood to enjoy outdoor facilities	- Properly maintained and operated the construction plant (well- greased, damage and worn parts promptly replaced)	
COM-2010-08-129		12 August 2010	The complaint was raised by the resident of Tregunter Path for the noisy works which was carried out after 18:00hrs at Intake TP4	mitigate noise generated by the works.	
COM-2010-08-129		12 August 2010	The complaint was received from Protech Property Management Limited (the building manager of	as below: Monday – Friday: 08:00hrs to 18:00hrs	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-08-129 (2)		13 August 2010	Tregunter Tower, 14 Tregunter Path, Mid-Levels, Hong Kong) regarding the noisy construction works at Tregunter Path The complaint was received by RSS concerning the noisy work from the construction	Sunday and Public Holiday: No Works	
COM-2010-10-151	Eastern Portal	15 October 2010	A complaint was received from the resident of The Legend through the supervising officer on 15th October 2010 about the construction dust nuisance from Eastern Portal Site Area.	Based on the information gathered in the investigation, no exceedance of air quality level was recorded at AQ1 since the commencement of the project works for Eastern Portal Site. The potential source of air quality impact arising from the removal of tunneling spoils from the tunnel portals as well as the vehicular emissions is minimized as all TBM excavation works have been completed since 5 October 2010.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-10-154	Eastern Portal	18 October 2010	A complaint was received from the resident of Ronsdale Garden through the DSD on 18th October 2010 about the construction noise nuisance from Eastern Portal Site Area. According to the complainant, the noise seems to be generated by a pump.	Based on the information gathered in the investigation, the noise levels measured at The Legend (NC2) and outside True Light Middle School of Hong Kong (NC1) were well below the limit level. The Contractor agreed to terminate the operation of pump during the evening (1900 – 2300) and night	Closed
COM-2010-10-155	Intake RR1	11 October 2010	A letter from the Property Management of Peaksville Court - Hong Yip Service Company Ltd was received by DNJV on 11th October 2010 about the construction noise nuisance and wastewater generated from Intake RR1 Site Area.	the investigation, the noise levels measured at Peaksville Court (NC13) and Ying Wa Girl's School (NC12) were below the baseline/limit level. In addition, water runoff was observed leaked out to the public	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				with sandbag as early as possible.	
COM-2010-11-160	Intake TP789	5 November 2010	The complaint was received from Kerry Property Management and advised that some complaints from the residents of Tavistock about low frequency noise generated by the power pack within Site Portion TP789.	Based on the information gathered in the investigation, the noise levels measured at near Intake TP789 were below the limit level after the Contractor implement noise	Closed
COM-2010-11-160(2)	Intake TP789	9 November 2010	Some residents complained the low frequency noise after the addition of sound proof sheets on the power pack at Intake TP789.	generation activities.	
COM-2010-11-163	Western Portal	6 November 2010	A complaint was received from Ms Cheung regarding noise nuisance caused by spoils dropping directly from conveyor belt into barge (rock hitting sound) at Western Portal.	Based on the information gathered in the investigation, the noise levels	Closed
COM-2010-11-163(2)	Western Portal	7 November 2010	A complaint was received from Ms Cheung regarding noise nuisance caused by spoils dropping from conveyor belt into storage basin (rock hitting sound). Ms Cheung also complained	limit level.	Closed


Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			the noise of ventilation fans at the Western Portal area.		
COM-2010-11-164	Intake TP5	10 November 2010	Kerry Property Management Services received several complaints from the residents of Valverde on 10 November 2010 morning regarding working noise emitted from the Intake TP5 work site in early morning (before 7:30am).	Base on the information collected, the ad-hoc noise monitoring results measured at near Valverde was met the acceptable noise levels. Drill and blast is not considered with respect to noise annoyance, as the duration of	
COM-2010-11-165	Intake TP5	15 and 17 November 2010	Kerry Property Management Ltd phoned DSD at about 17:08 hrs on 15 November 2010 relaying some complaints from the residents of Valverde about the noise/vibration due to the blasting works in past weeks. Jennifer also requested DNJV not to carry out blasting works at nights.		Closed
COM-2010-12-170	Intake DG1	7 December 2010	The complaint was received regarding the noise arising from the excavation works, starting from 9:00 hrs, in the construction site near Evergreen Villa of Stubbs Road.	the Investigation, the noise levels measured at NC4 and NC6 in November and December 2010 were below the construction noise limit	


Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				The Contractor has taken initiative to erect noise absorption blankets at the site boundary to minimize noise nuisance to the nearby residents.	
				The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.	
COM-2010-12-171	Intake MB16	8 December 2010	The complainant complained the works near Mount Butler Road generated dust, thus affecting the air quality in the vicinity.	at the entrance of Area B. In addition, Environmental Team and	Closed
COM-2010-12-173	Intake W5	14 December 2010	A complaint was received from Ms Lo regarding noisy construction activities at Site Portion W5 had affected her niece's study to prepare for examination.	at the subject site under Hong Kong West Drainage Tunnel project. The construction work at Site Portion is	Closed


Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				closely monitor the works in order to mitigate the noise impact to the nearby residents.	
COM-2010-12-178	Intake TP5	22 December 2010	Kerry Property Management Ltd notified that some complaints from the residents regarding the early commencement of the noise works at Intake Ste TP5 (earlier than 08:00hrs) in the past few days.	As advised by DNJV on 23 December 2010, they would carry out the work at site portion TP5 from 08:00 hrs to 19:00 hrs. Eddie Yau, DNJV Public Relation Manager had already explained to Kerry about the	Closed
COM-2010-12-179	Eastern Portal	24 December 2010	The Property Management Office of The Legend referred the complaint from the resident to DSD regarding the intermediate noise from Eastern Portal site portion in the morning and at night.	Based on the information gathered in the investigation, the noise levels measured at NC1 and NC2 were below the limit level	Closed
COM-2011-01-181	Eastern Portal	21 January 2011	The Property Management Office of Legend called DNJV to reflect a resident's concern on early construction noise at 8:30am on Saturday.	the investigation, the noise levels measured at NC1 and NC2 were	Closed
COM-2011-02-186	Intake GL1	18 February 2011	A complaint was received from the resident of Green Lane through the ICC on 18th February 2011 about the construction noise generated	the investigation, the noise levels measured at near Green Lane was marginal below the construction	Closed


Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			from the plant equipments	However, the Contractor has already	
			being operated at Intake GL1	1	
			from early in the morning and	measures to reduce noise impact.	
			ends at around 19:00 at night.	The major noise source due to the	
				raise boring works has been finished since 26th February 2011	
COM-2011-02-188	Western Portal	25 February 2011	The complaint was received from the resident of Bel Air, Mr Wong, who called hotline at 3am and 4pm on 25 Feb 2011 to complaint about noise. The complainant refuses to give details on the nosie. He claims that he will report this to the Police and requested DNJV to provide him with copy of CNP.		N/A


APPENDIX M CONSTRUCTION PROGRAMME

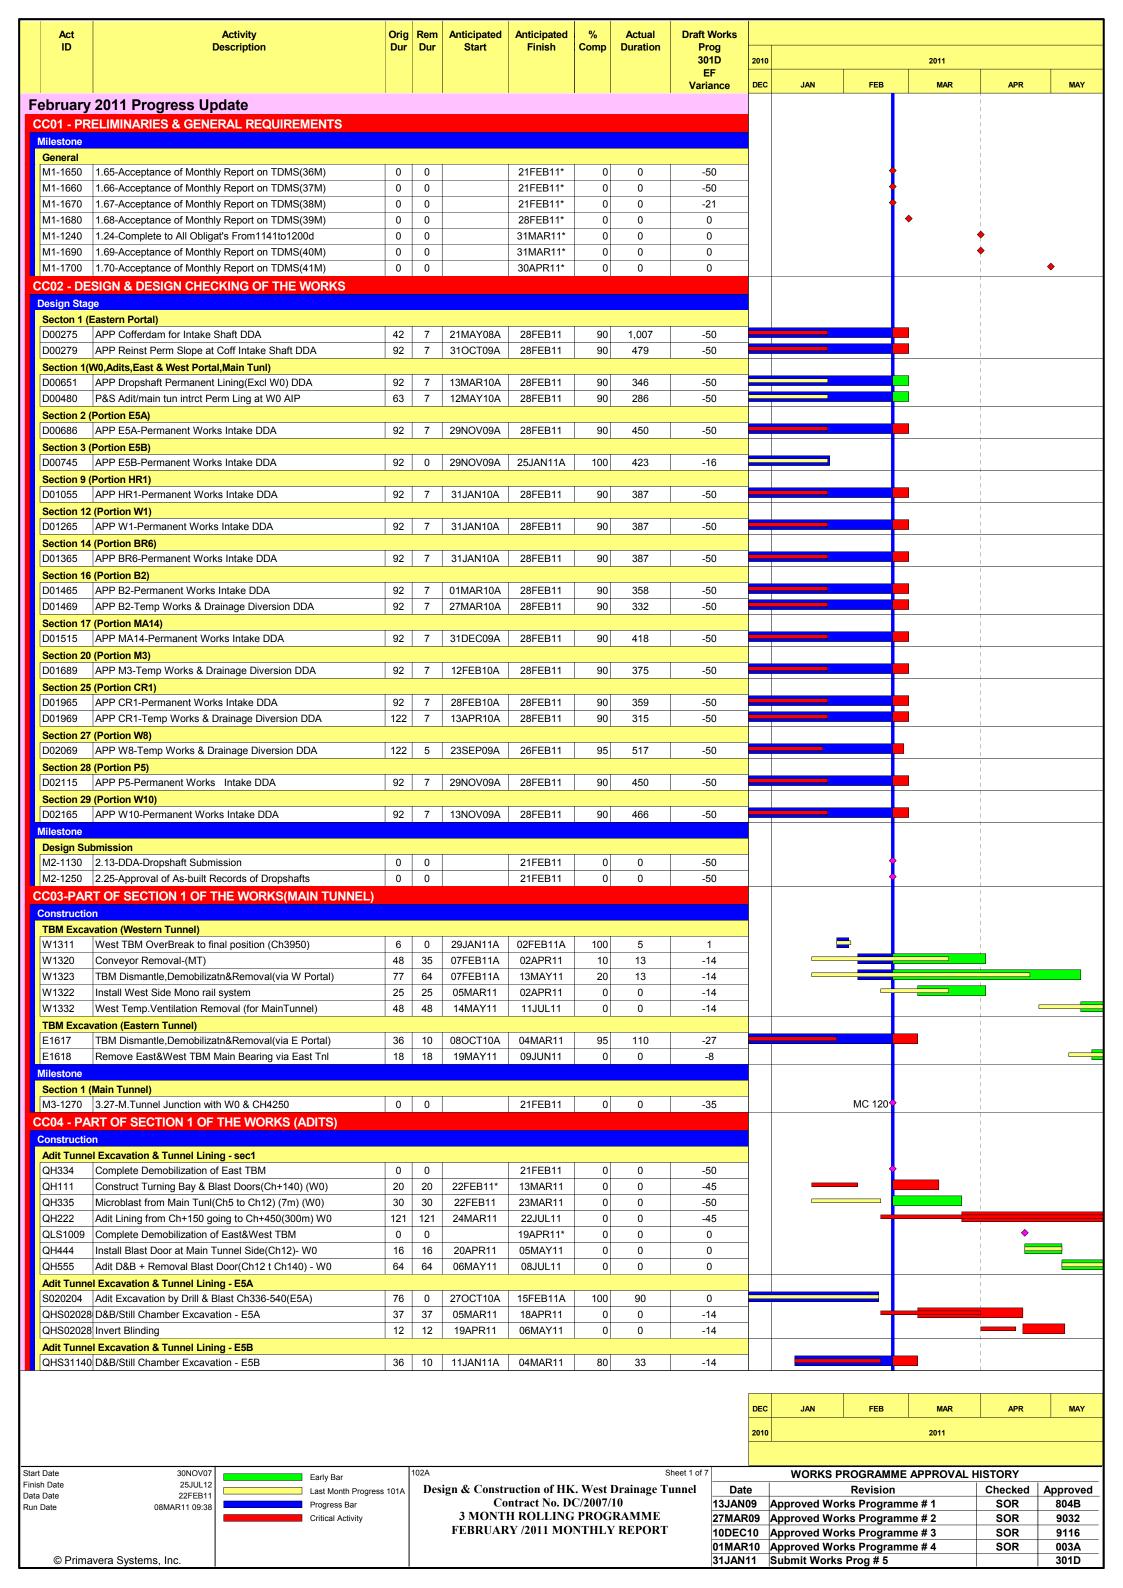


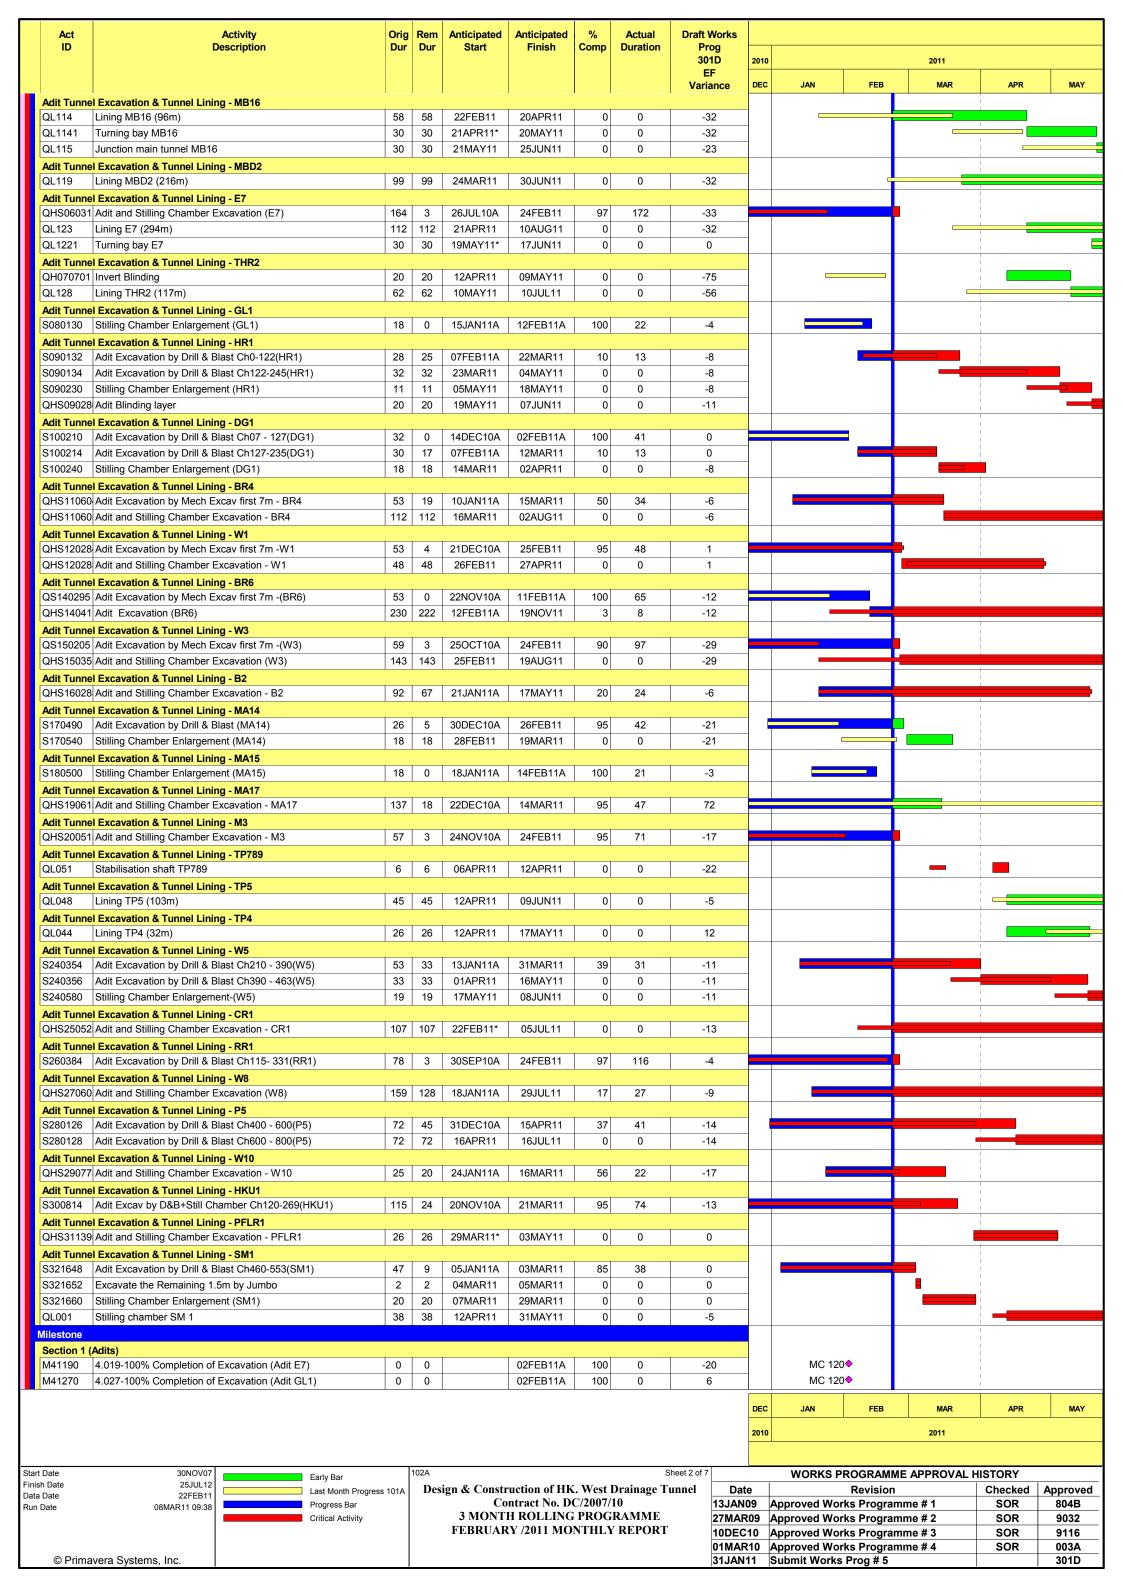


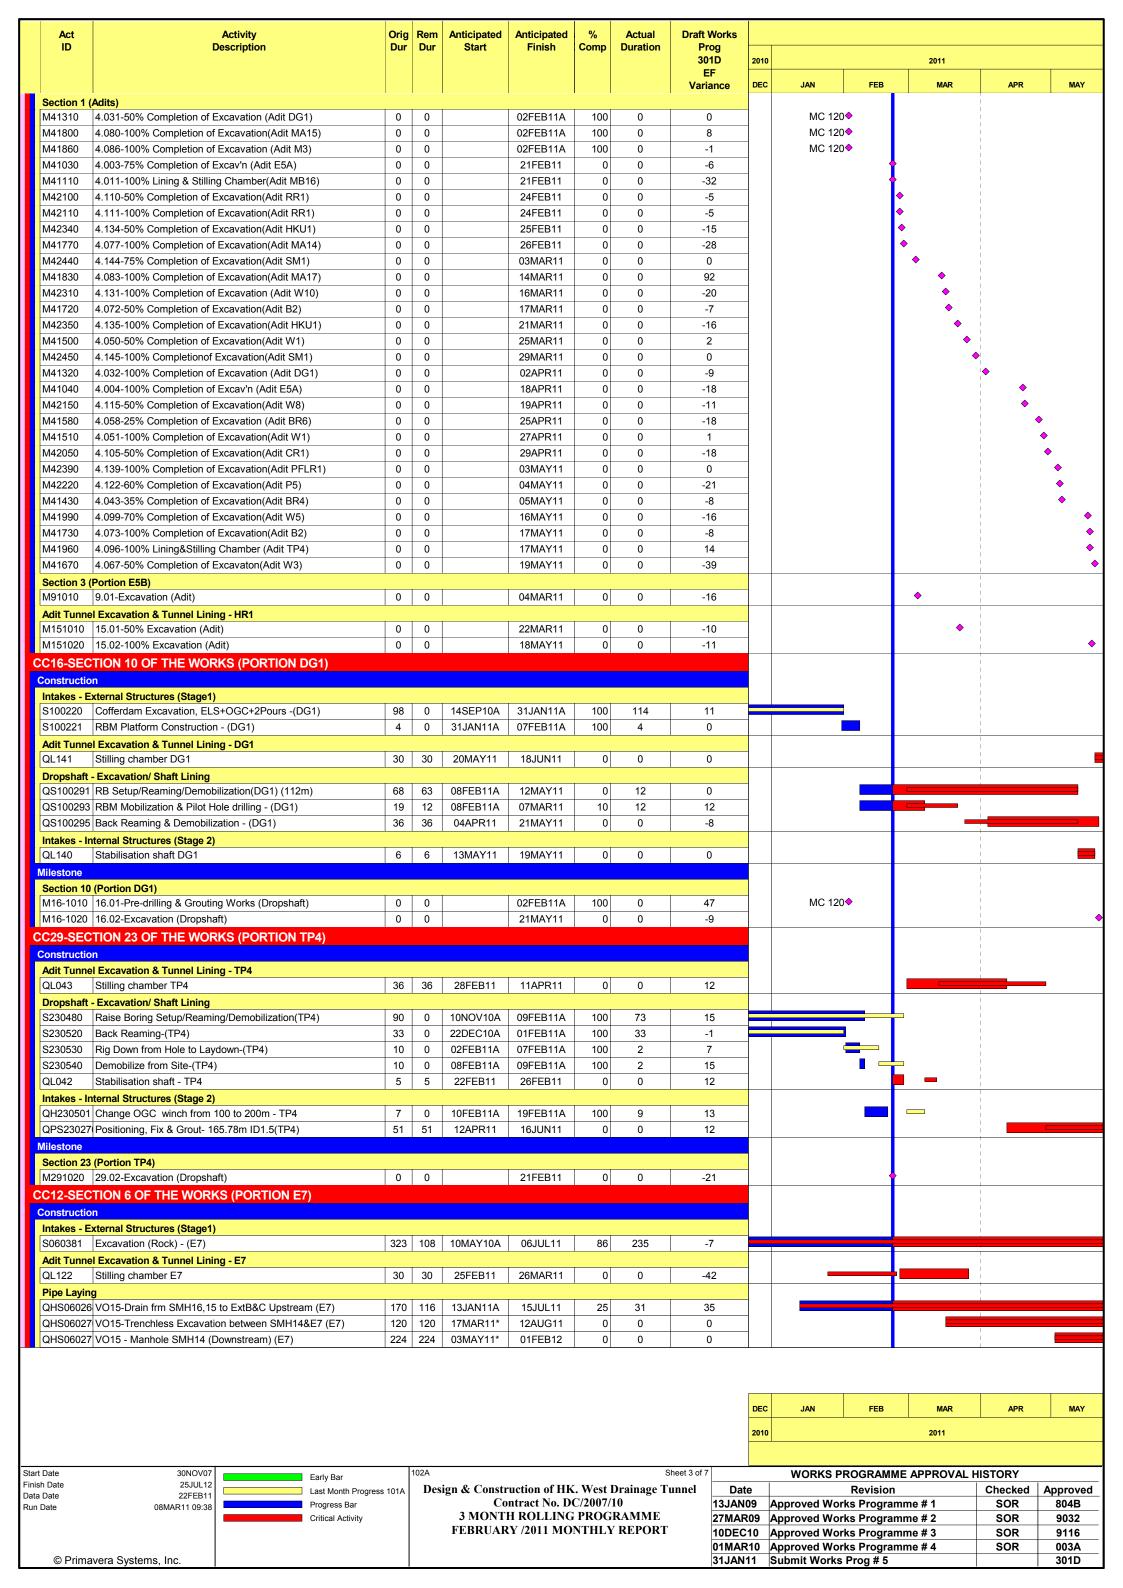

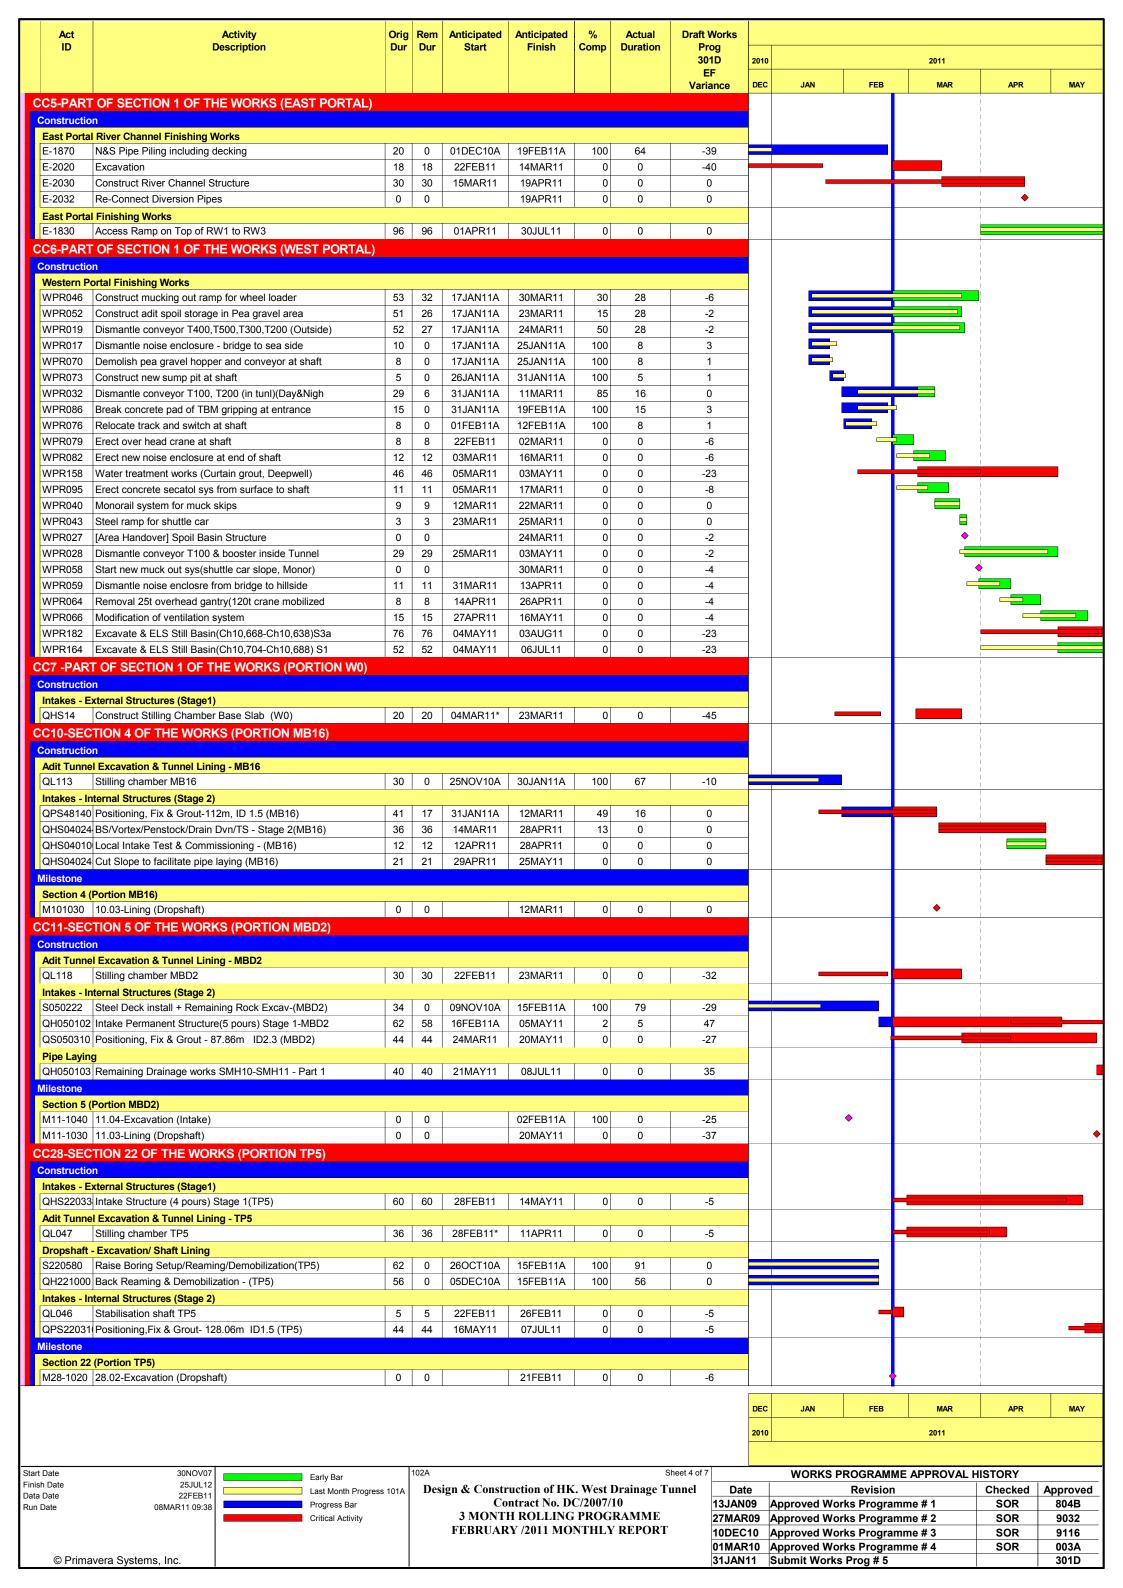

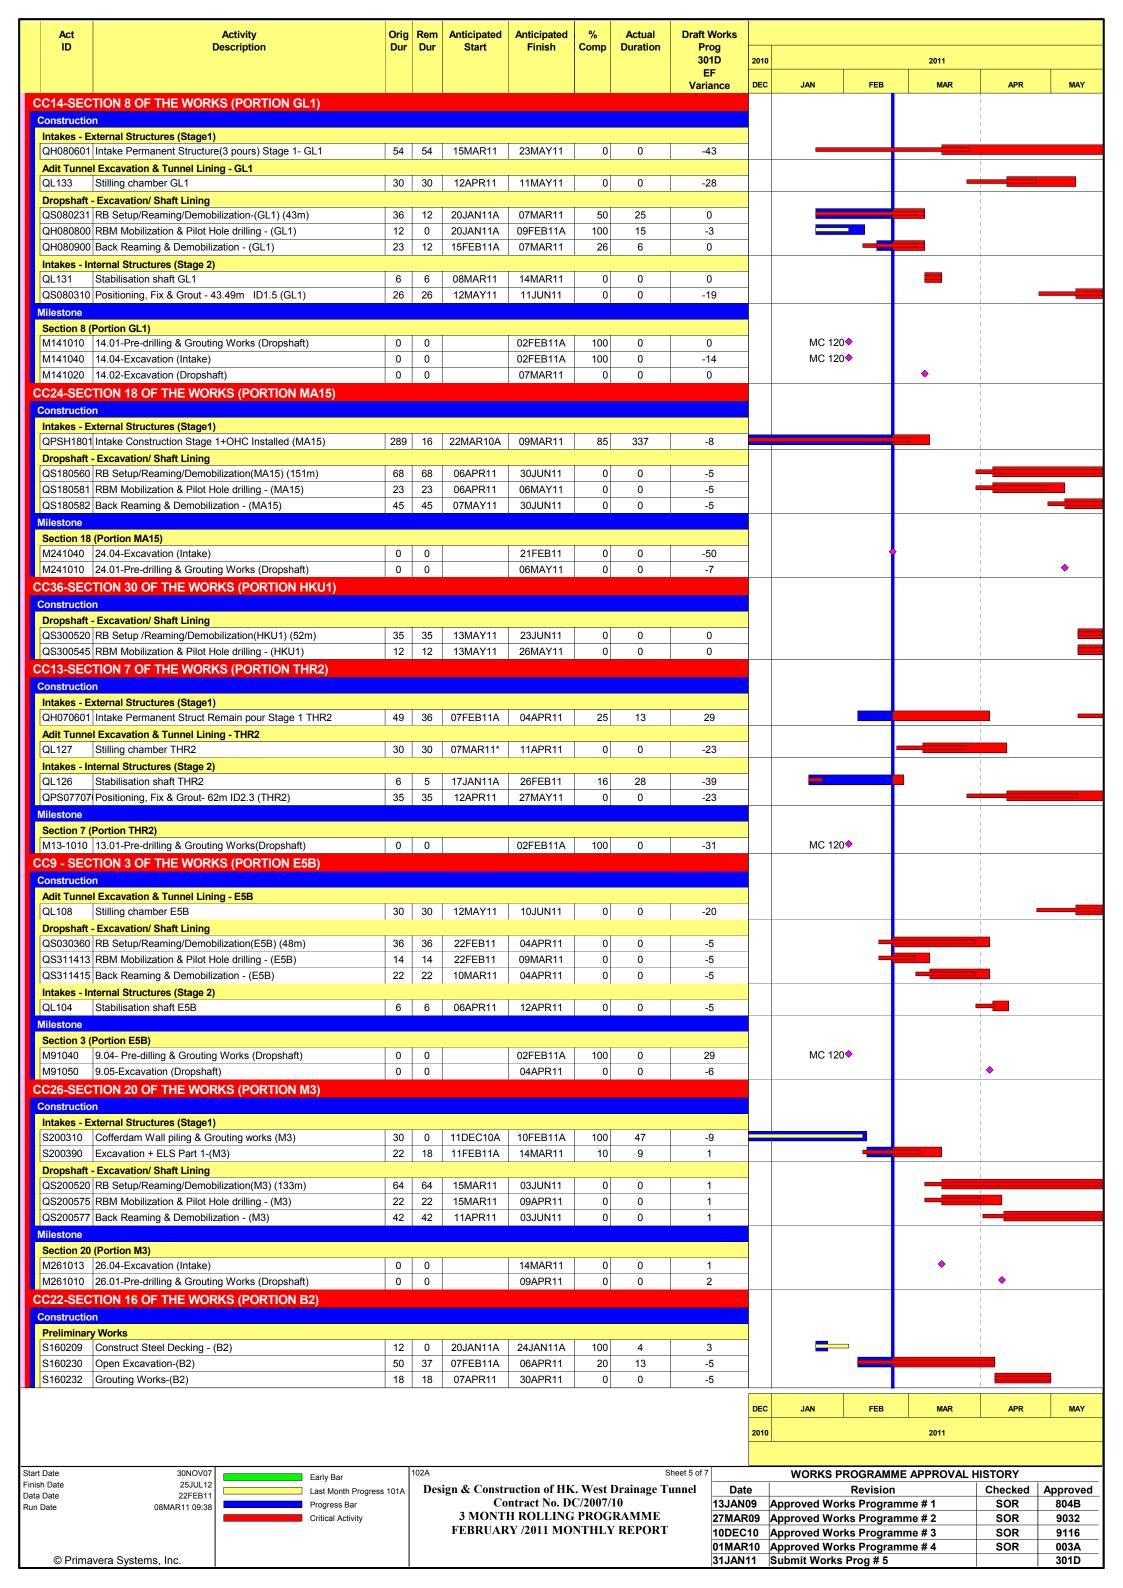

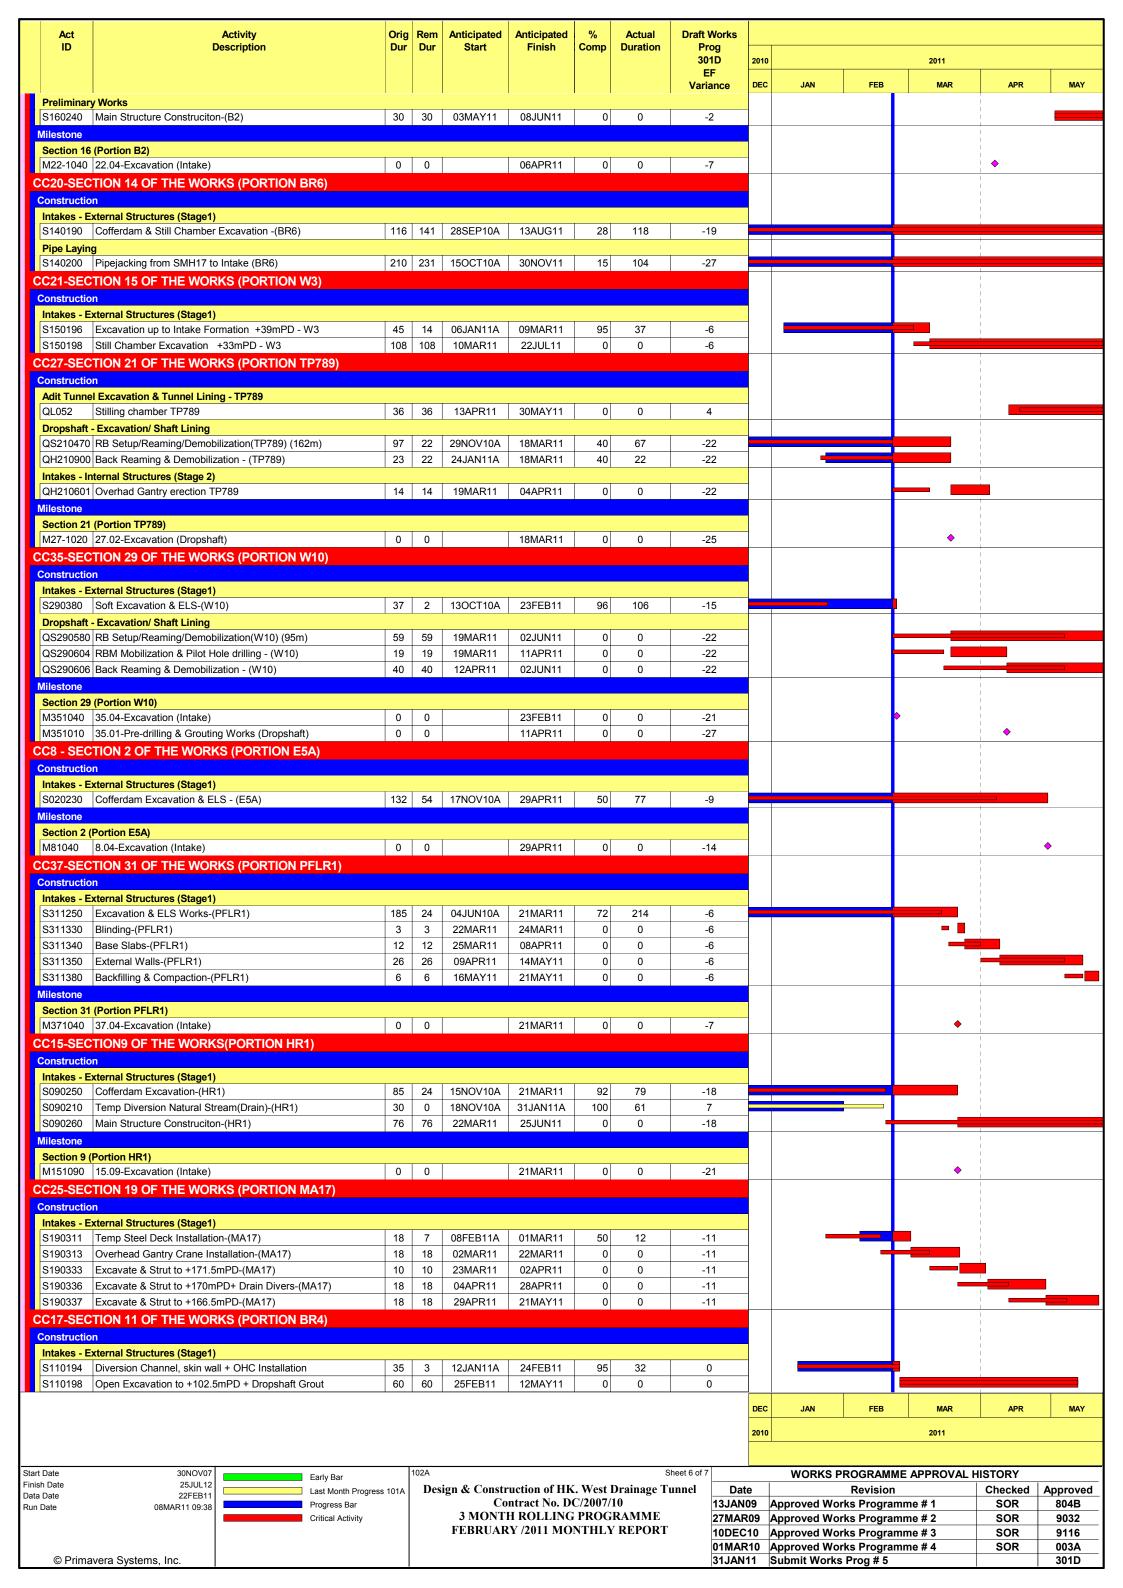

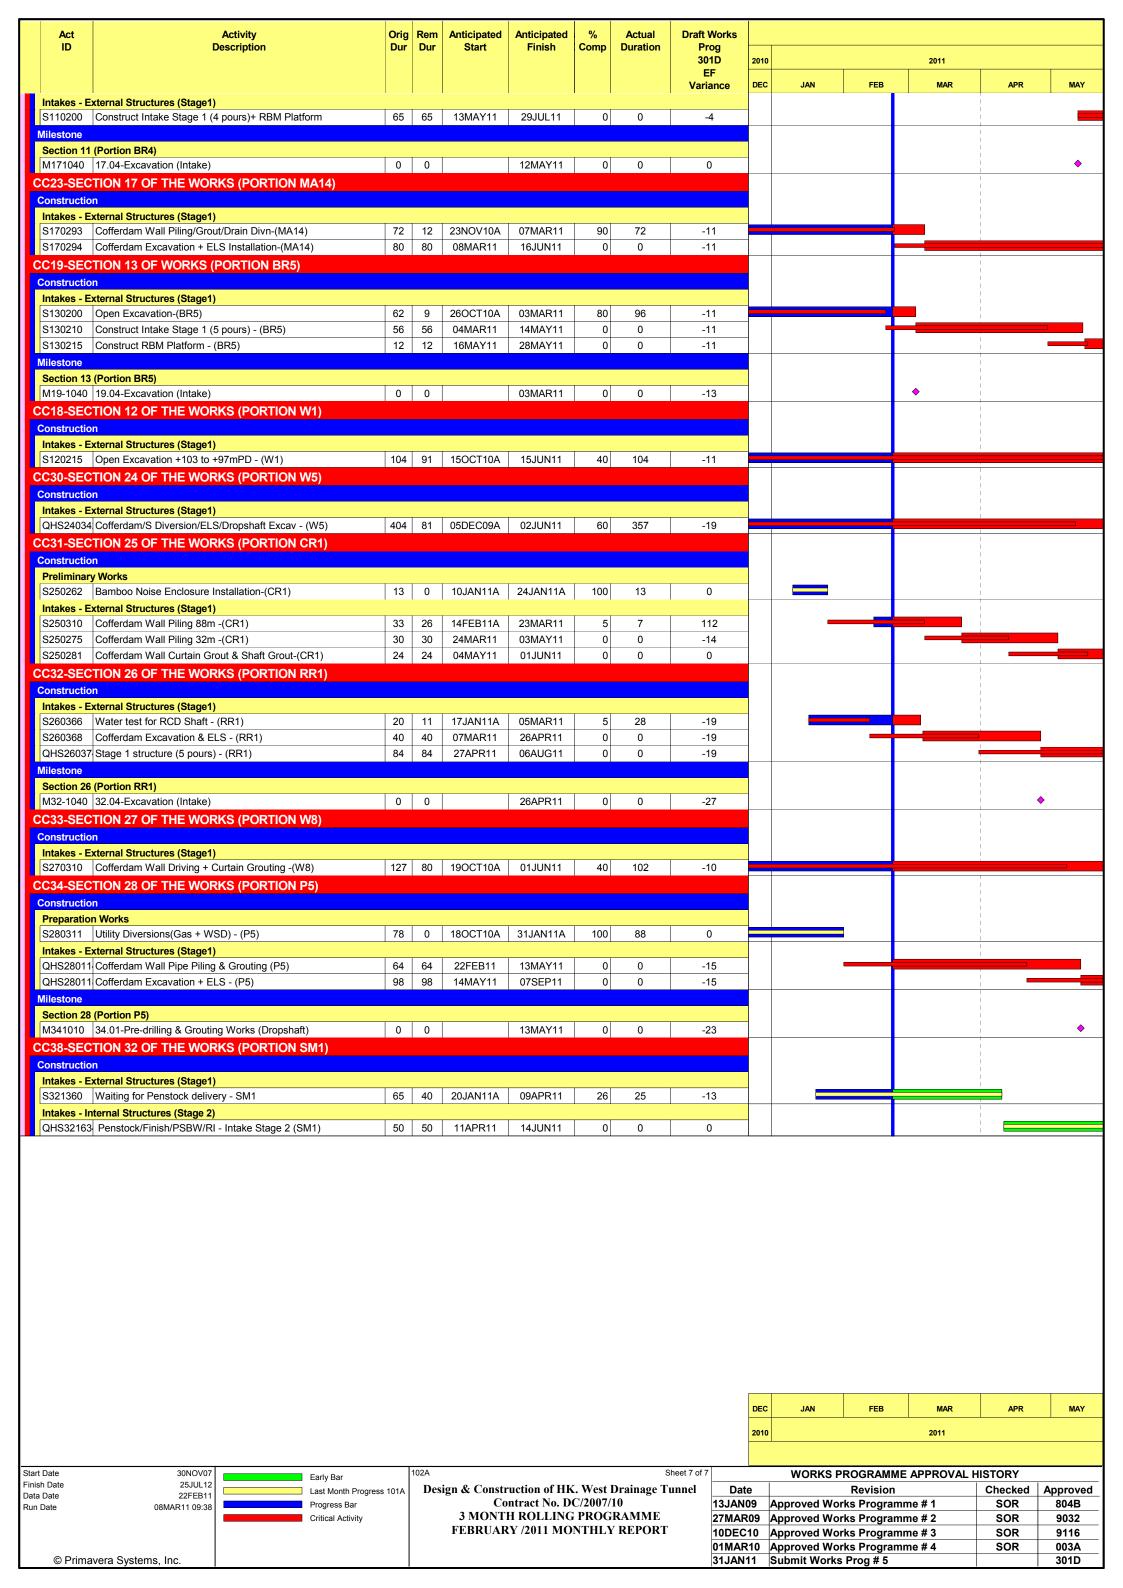

APPENDIX N WASTE GENERATED QUANTITY

Monthly Waste Flow Table

		Actual	Quantities of In	ert C&D Materia	als Generated N	Monthly	Actu	al Quantities o	f C&D Wastes	Generated Mo	onthly
Quarter ending	Total Quantity Generated	Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see notes 2)	Chemical Waste	Others, e.g. general refuse
	(in m ³)	(in m ³)	(in m ³)	(in m ³)	(in m ³)	(in m ³)	(in Kg)	(in Kg)	(in Kg)	(in Kg)	(in m ³)
Jan 2011	24478		24	22424	1992	38	25905	385		0	84
Feb 2011	11114		0	10034	1080	0	128470	385		4924	73
Mar 2011											
Apr 2011											
May 2011											
Jun 2011											
Sub-Total	35592		24	32458	3072		154375	770		4924	157
July 2011											
Aug 2011											
Sep 2011											
Oct 2011	·										
Nov 2011	·										
Dec 2011											
Total											

Notes:

- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (2) Plastics refer to plastic bottles/containers, plastic/foam from packaging material.
- (3) Quantities in February 2011 are upto 28 February 2011.
- (4) Assuming the conversion factor from m³ to ton for rock is 2.5.
- (5) The materials reused in other Project shall not be treated as waste under the Waste Disposal Ordinance (Cap 354).
- (6) The figures are included for the sake of completeness of record.

ANNEX I
REVIEW REPORT FOR "HANDLING &
DELIVERY OF EXCAVATED
MATERIALS AT THE WESTERN
PORTAL"

Background

1. Project

"Dragages - Nishimatsu Joint Venture (DNJV)" is the principal contractor undertaking the contract work (DSD Contract No.: DC/2007/10) for the construction of:

- A drainage tunnel (Main Tunnel) from Tai Hang to Cyberport, having an internal diameter from 6.25m to 7.25m;
- A network of adits connecting to the Main Tunnel; and
- 32 intakes to collect surface runoffs into the Main Tunnel via the adit network. The water collected will be discharged into the sea at Cyberport.

The entire drainage tunnel network is built in rock strata, composed of granite and volcanic rocks. Two tunnel boring machines (TBM) are employed for the excavation of the Main Tunnel – one TBM is driving from the East to West whereas the other TBM is operating from West to East. The two tunnels will be broken through at a point near Stubb Road. The conventional drill and blast method is adopted for the excavation of the adits. The excavation of the Main Tunnels and the adits are concurrently carried out.

In addition, mechanical excavation, raise boring method, reverse circulation drilling and handdug caisson are used for the excavation of intakes cofferdam and dropshafts.

To facilitate the operation of the TBM and tunnel excavation, a temporary barging point was formed at the Western Portal in Cyberport to provide support for the supplies to both TBM; for handling of excavated materials; and for the berthing of vessels.

In the West Tunnel, the excavated materials generated from the TBM operations are delivered by a conveyor belt to the tunnel portal and are discharged either onto the barge or the TBM Spoil Basin. On the other hand, materials generated by drill-and-blast method in the adits are delivered to the Adit Spoil Basin at the portal for subsequent discharge onto the barge.

All excavated materials generated from tunneling operations at the West Portal are delivered by barges to the approved disposal ground for recycling use.

2. Environmental Impact Assessment (EIA)

The Work is a "designated project" under Schedule 2 of Environmental Impact Assessment Ordinance, Cap. 499. An EIA Study has been undertaken by Black & Veatch Hong Kong Ltd. for the Project to provide information on the nature and extent of potential environmental impacts arising from the construction and operation of the Project and related activities taking place concurrently, and to contribute to decisions on the overall environmental acceptability of the Project.

The EIA Report was issued in January 2006, and was approved by EPD under the EIAO (Register No.: AEIAR-099/2006 dated 7-Apr-06). In March 2006, Drainage Services Department (DSD) commissioned Ove Arup and Partners Hong Kong Limited (Arup) to undertake the consultancy assignment of Agreement No. CE 17/2005 (DS), based upon more detailed design information. The Technical Note on Supplementary Environmental Assessment was issued on 29-Mar-07 to highlight the changes since the approval of the EIA Report; evaluate the associated environmental implications; and review the mitigation measures required.

The following is mentioned in Chapter 6: Air Quality Assessment of the EIA Report (Register No.: AEIAR-099/2006) prepared by Black & Veatch:

"6.5.7 For Western portal, spoil generated will be delivery to barges by means of a covered conveyor belt. As a result, the number of vehicles entering the site will be reduced hugely and no vehicle-generated air pollution problems will arise. However, dust may be emitted from the transfer points of the conveyor. Proper design and maintenance of the conveyor will reduce dust emissions from the transfer points to ensure low dust impact."

The intent of this Clause is to reduce the impact on air quality arising from handling and delivery of spoil to a minimum.

There are comments from concerned groups over the site arrangements for the handling and delivery of excavated materials from the tunnel and adits.

3. Environmental Permit

The Environmental Permit (EP-272/2007) was first issued to DSD on 26-Apr-07. An application for construction and operation of the designated project was subsequently made and the revised Permit (EP-272/2007/A) was issued on 26-Oct-07. After the award of the Contract, DNJV applied for the issue of Further Environmental Permit (FEP-01/272/2007/A) which was subsequently issued on 28-Jan-08. A variation to the Further Environmental Permit was made in June 2009 and the revised Permit (FEP-01/272/2007/B) was issued on 25-Jun-09.

Purpose and Scope

A review was performed on the current site arrangements on the delivery and handling of excavated materials, particularly the Western Portal, within the context of the EIA Report and over their impact on the environment.

Delivery and Handling of Excavated Materials

1. Excavated Materials from TBM

Excavated materials generated from the operation of the tunnel boring machine are small (often less than 100mm) and the sizes are quite uniform. These materials are carried by a covered conveyor belt system installed near the crown of the Main Tunnel; and are discharged directly onto the barge berthed at the seawall. Owing to the mode of TBM operation, there are times that TBM excavated materials must be re-handled.

Typical examples include:

• A barge is already full and has to leave the Site. When there is no barge at the seawall, the materials will be discharged into the TBM Spoil Basin.

• When the TBM operates during night time, we have to discharge the TBM excavated materials into the TBM Spoil Basin in accordance with the conditions of the Construction Noise Permit in force.

When the next barge comes during daytime, the materials stored in the TBM Spoil Basin will be picked up by a backhoe and are transferred into a side conveyor. The side conveyor carried the materials to the main conveyor for discharge onto the barge (*Photo 1*).



Photo 1: View of the Western Portal

The Main Conveyor and the Side Conveyor are fully enclosed by sound absorptive panels.

2. Excavated Materials from Drill-and-Blast Adits

Excavated materials generated by drill-and-blast are bigger (over 200mm) and they are of irregular sizes and shapes.

The materials are picked up by either the Häggloader (*Photo 2*) or the John Deere skid loader (*Photo 3*) at the adit face; and they are then transferred onto train cars (Shuttle Cars as in *Photo 4*). These Shuttle Cars will be brought to the Adit Spoil Basin at the tunnel portal (*Photo 5*). A backhoe is deployed at the surface adjacent to the Adit Spoil Basin transferring the excavated materials from the Adit Spoil Basin onto a 24-T dump truck that travels less than 100m within the Site from the Adit Spoil to the ramp jetty and vice versa.

The Adit Spoil Basin is provided with noise covers such that the entire basin is fully enclosed for nighttime operation.

The ramp jetty is enclosed at 3 sides – the top and the lateral sides. It is equipped with curtains and water sprinkler system for dust suppression. (*Photo* 6 & 7)



Photo 2: Häggloader



<u>Photo 5</u>: Shuttle car discharging excavated materials at the Adit Spoil Basin



Photo 3: John Deere Skid Loader



Photo 6: The Ramp Jetty



Photo 4: Shuttle Car



Photo 7: Dump truck discharging excavated materials onto the barge at the ramp jetty

Environmental Considerations

DNJV chooses the current mode of handling and delivery of excavated materials after careful consideration to its impact on the environment. (i.e. TBM excavated materials by conveyor belt onto barge or the TBM Spoil Basin; and Adit excavated materials by trains to the Adit Spoil Basin and onto the barge by dump trucks)

It is because excavated materials from Drill-and-Blast Adits cannot be handled by a conveyor system due to their big sizes and heavy weight. If a conveyor system was used, we need to mechanically break the materials into small chunks at the portal surface, using hydraulic breakers or by other means. That will certainly have an impact to the environment (e.g. more noise produced, more dust generated, more diesel fuel consumed).

All wastewater collected from surface runoffs and from the spoil basins are pumped into Wetsep and the water treatment plant at the Western Portal for treatment before discharge into the sea in accordance with the conditions of the Effluent Discharge Licences in force.

The current mode of operation has the least impact to the environment in terms of noise, air and water. Mitigating measures in place at the Western Portal are described in details in the next section. Moreover, excavated materials from TBM operation (uniform size) and those from drill-and-blast operations in the adits (irregular sizes) are delivered to the approved disposal locations for reuse (e.g. site formation).

Environmental Mitigation Measures at Western Portal

1. Covered Conveyors

Both the main and side conveyors (*Photo 8*) are entirely covered to mitigate noise propagation and avoid fugitive dust during the transportation of excavated materials.

2. Dust Suppression

- A sprinkler system (*Photo 9*) was installed underneath the ramp jetty for dust suppression when excavated materials are being loaded onto the barge.
- Dust curtains (*Photo 10*) were also installed at the outer rims of the conveyor enclosure in order to shield fugitive dust, if any, arising from the discharge of excavated materials from the conveyor.
- The 24T dump truck transporting materials from the Adit Spoil Basin to the ramp jetty is fitted with mechanical covers.

3. Noise Enclosure at Western Portal and the Adit Spoil Basin

All logistics movements take place inside a sophisticated and purposely-built acoustic enclosure. Mobile plant such as locomotives and train cars are travelling inside the noise enclosure and into the tunnel under construction. In addition, movable noise covers (*Photo 11*) were provided in the Adit Spoil basin to block noise propagation during the unloading of excavated materials from the shuttle cars.

4. Noise Barriers at Western Portal

In addition to the noise enclosure erected at the Western Portal, a row of noise barrier was built in the Western Portal adjacent the pea gravel storage yard (*Photo 12*). The barrier does not only screen the mobile plant at the pea gravel storage yard from the views of the Aegean Terrace residents, but it shields part of the noise generated from the operation of such plant. There is another row of barriers erected at the side abutting the Cyberport Road (*Photo 13*).



Photo 8: Covered Conveyors



<u>Photo 9</u>: Sprinkler system installed at the ramp jetty

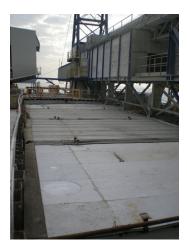


Photo 11: Noise covers at the Adit Spoil Basin



<u>Photo 12</u>: Noise barrier at the pea gravel storage yard at the side facing Aegean Terrace



Photo 10: Dust curtains at the discharge point



Photo 13: Noise barrier along Cyberport Road


Air Quality Monitoring

DNJV has been undertaking the 24-hour Total Suspended Particulates (TSP) monitoring since commencement of the Work. The TSP station is installed within our site boundaries rather than the designated location at Aegean Terrace as stipulated in the E&MA Manual. The reason is that residents at Aegean Terrace refused to allow the environmental team to set up the instrument on their premises. Sampling and analysis are conducted by an HOKLAS laboratory to collect TSP filtering sample in a frequency of once every 6 days.

The 24-hour TSP monitoring results indicate that the TSP levels are all below Action (156 μ g/m³). No exceedance on monitoring limits was recorded. The agreed and pre-set Action and Limit levels and the actual TSP monitoring levels in the past 4 months are shown below.

The impact on air quality arising from the handling and delivery of excavated material is insignificant.

	TSP level
Date	(μg/m ³)
7-Apr	108
13-Apr	47.6
19-Apr	123.9
24-Apr	135.5
30-Apr	62.2
6-May	60.7
12-May	86.5
18-May	103.6
24-May	133.5
29-May	68.5
4-Jun	94.9
10-Jun	38.0
15-Jun	74.5
21-Jun	53.4
26-Jun	39.0
2-Jul	63.9
8-Jul	95.9
14-Jul	84.6
20-Jul	116.6
26-Jul	117.8
31-Jul	89.7
6-Aug	102.8
12-Aug	42.0
18-Aug	103.8

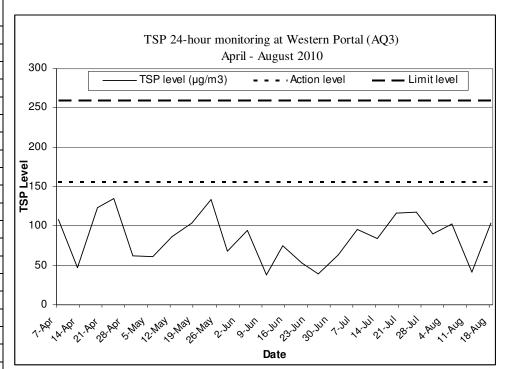


Environmental Noise Monitoring


The E&MA Programme requires the carrying out of baseline noise monitoring prior to the commencement of construction work and impact noise monitoring when actual construction work started on the Site. DNJV employs an environmental team to conduct periodic noise monitoring during daytime, evening and nighttime. The designated noise monitoring station is adjacent to the Aegean Terrace, the nearest noise sensitive receiver. The daytime noise levels in the months from April to August as well as corresponding readings during daytime, evening and nighttime in the previous quarter are tabulated and graphically illustrated below.

There is no exceedance of noise levels recorded in the past 4 months. The noise impact arising from the handling and delivery of excavated material is insignificant.


	Noise level	
Date	(dB(A))	
1-Apr	62.2	
8-Apr	61.0	
14-Apr	57.9	
20-Apr	54.8	
26-Apr	63.6	
3-May	61.3	
13-May	59.8	
19-May	56.9	
25-May	54.9	
31-May	56.7	
8-Jun	52.7	
18-Jun	59.3	
22-Jun	63.9	
29-Jun	55.9	
8-Jul	51.8	
13-Jul	55.3	
20-Jul	54.7	
26-Jul	56.7	
3-Aug	52.7	
9-Aug	54.8	
19-Aug	57.8	

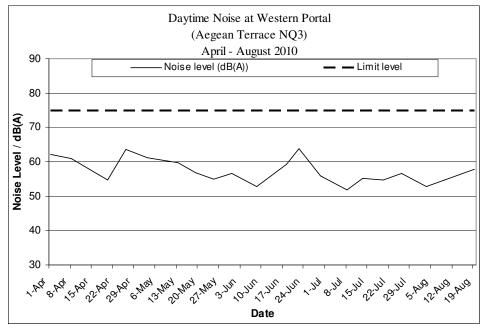


Noise Levels

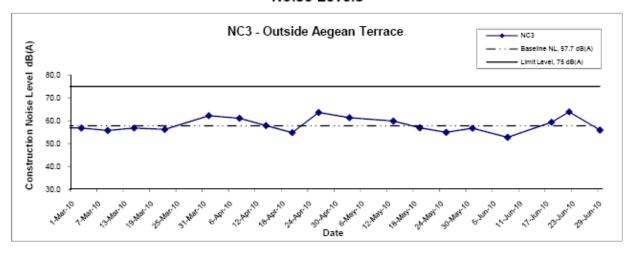

Noise Levels (Restricted Hours - 07:00 - 23:00 holidays & 19:00 - 23:00 on all other days)

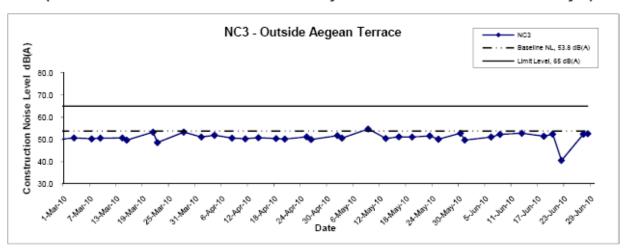

Noise Levels (Restricted Hours - 23:00 to 07:00 on all days)

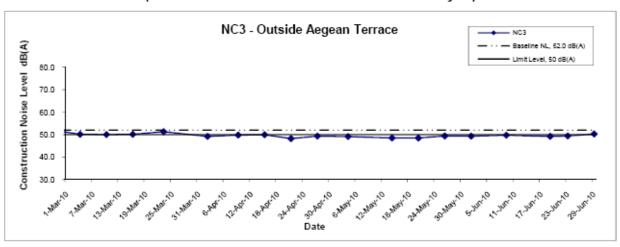

Conclusion

The current mode of handling and delivery of excavated materials from TBM operation and adit excavation (drill-and-blast) has insignificant impact to the environment. It does not deviate from the intent of the EIA Report on the control of air quality – Clause 6.5.7 of the Report, and does not constitute material change of the EIA of Hong Kong West Drainage Tunnel Project.

It also concludes that the current spoil transportation arrangement does not constitute a breach of Condition 1.7 of the Further Environmental Permit that the HKWDT Project is designed and constructed in accordance with the information and all recommendations described in the EIA Report.

Appropriate mitigation measures are designed and implemented with due consideration of actual work method and site constraints to ensure compliance with the respective air quality and noise emission limits at the nearby sensitive receivers. These are in line with the recommendations of the EIA Report and comply with the conditions of the Further Environmental Permit.

ANNEX II PROPOSAL OF TWO BLASTS PER DAY IN WESTERN ADITS

Proposal of Two Blasts Per Day in Western Adits

1. Objectives

The objectives of this document are to:

- Explain the proposed arrangement of 2 blasts per day and the construction sequence,
- Review environmental implications and mitigation of the proposed arrangement,
- Review the related documents under EIA Ordinance to check whether there are any conditions/restrictions applicable to the proposed blasting arrangement.

2. The Project

The Hong Kong West Drainage Tunnel (DSD Contract No.: DC/2007/10) is a stormwater drainage tunnel running between Tai Hang (Eastern Portal) and Cyberport (Western Portal) with a network of adit tunnels. It is designed to collect stormwater from the upper catchments by a system of intake points, dropshafts and adits to relieve the flooding problem at the lower catchments of northern Hong Kong Island during heavy rainstorms. The Main Tunnel comprises 2 tunnel sections, namely:

- A main tunnel with internal diameter of 6.25m from Ch+43 (Eastern Portal) to Ch3+955.
- A main tunnel with internal diameter of 7.25m from Ch3+955 to Ch10+534 (Western Portal)

The 2 Main Tunnel Sections are excavated by the operation of 2 tunnel boring machines (TBM). On the other hand, the adits are excavated by drill and blast method.

3. Blasting in the West Adits

DNJV is currently adopting drill and blast method for the construction of the Western Adits. The blasting direction is from the Main Tunnel towards the intake dropshafts. For safety reason and full evacuation of personnel from the TBM, blasting can only be commenced when the TBM excavation has progressed some 200m beyond the adit and tunnel junction. This criterion is a restriction to the progress of adit excavation (especially when hard ground conditions or fault zones are encountered) though a number of adits can be excavated concurrently by drill and blast (*concurrent blasting*).

At present, drill and blast operation is now being conducted at 8 adits (including SM1, P5, HKU1, RR1, W5, TP4, TP5 and TP789) <u>concurrently</u> during daytime. It is worthwhile noting that the blasting faces are located from 2,100m to 4,200m from the tunnel portal.

Figure 1 illustrates the alignment of the West Tunnel and West Adits and the progress of TBM excavation in the West Tunnel.

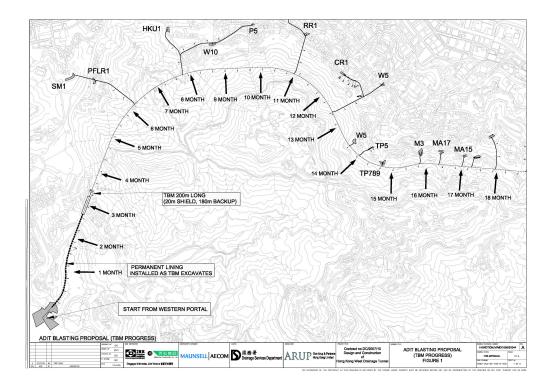


Figure 1: West Tunnel/Adit Alignment and TBM Progress

Lockable blast doors are installed at each main tunnel and adit junction where blasting is to be carried out. Besides, ventilation fans are installed to induce forced ventilation during mucking out and extraction ventilation immediately after blasting.

All daily blasting are carried out at the same time and therefore all adit working faces will be cleared prior to blasting the charged adits along the entire section of the tunnel. The daytime blasting window is somewhere between 13:00 hours and 19:00 hours. A typical work cycle includes the following activities:


- (1) Drilling
- (2) Charging
- (3) Blasting
- (4) Ventilation (extraction of blast fumes)
- (5) Inspection (check for misfire and loose rocks)
- (6) Mucking
- (7) Installation of temporary tunnel support
- (8) Survey/mapping

Owing to the working cycle for a single concurrent blast and the progress of the tunneling works (the adits to be blasted are getting deeper and deeper in the Main Tunnel), the daytime blasting schedule is pushed to the latter part of the blasting window.

4. Two Blasts Per Day

The Hong Kong West Drainage Tunnel Project is a flood relief programme for the northern shore of Hong Kong Island. The timely completion of the Project is important to the safety of the people living in the low-lying areas along the northern shore of Hong Kong Island. DNJV proposes to increase the blasting work to two times per day to ensure timely completion of the Project, especially when unexpected ground conditions are encountered during adit excavation. Two blasts per days are planned initially for the Adits leading to Intakes HKU1, W10 and P5.

Because of the time taken for a typical work cycle, it is anticipated that the second blast will take place in the early hours of the day (around 01:00 to 03:00 hours).

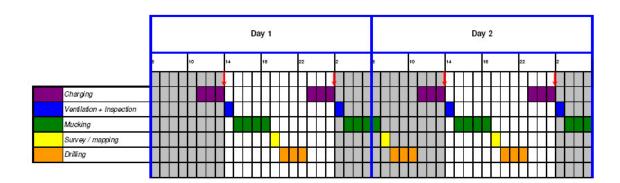

For the planned arrangement for two blasts per day, it is important to note the following points: -

- (1) The blasting faces are currently located from 2,100m to 4,200m from the tunnel portal and 120m 150m below the surface. The distances will increase as tunnel and adit excavation progress. Besides, the blast faces
- (2) For nighttime blasting, DNJV will attempt to limit the number of blast faces (1 to 2).
- (3) There is no change in construction methodology for adit excavation. As mentioned in the EIA Report, blasting is seen as the most suitable method of excavation for adits.
- (4) There is no change in the number and type of prescribed powered mechanical equipment used in the nighttime blasting.
- (5) There is no overnight storage of explosives on Site. There will two deliveries of explosives to Site by the Mines Division one in the morning and the other in late afternoon. The explosives will be delivered to the blasting locations inside tunnel by means of a special train and under the strict supervision by the Mines Department.

5. Environmental Implications and Mitigations

Air Quality

- Water sprinklers and water spraying are used to suppress dust and fumes generated by blasting.
- A fume scrubber is installed at the tunnel portal for further dust and fume suppression.
- The TSP monitoring station is now installed within the site boundaries at the Western Portal. Air monitoring has been carried out since the commencement of construction work. No exceedance has been registered even after adit blasting was conducted inside the tunnel.

Noise

- No new plant and equipment will be introduced as a result of 2 blasts per day or nighttime blasting. The existing powered mechanical plant pertaining to works under restricted hours both at the surface and inside tunnel still apply. A Construction Noise Permit (GW-RS0774-10) was granted to cover all PME essential for the drill & blast works and nighttime operation.
- Blast doors will be installed at the tunnel and adit junctions to confine the blast areas.
- As the blasting faces are all deep inside the tunnel (the rock cover 120m -150m), the number of blast faces is limited and the noise generated during blasting is transient in nature, the noise impact on the nearby communities will be insignificant.
- The noise enclosure at the tunnel portal area will remain, allowing for operation of PME within the enclosure during restricted hours.
- Noise monitoring at designated locations as described in the EM&A Manual will continue.

Photos of Mitigation Measures for Blasting Works



Blast door at tunnel and adit junction



Blast door at tunnel and adit junction for microblasting



Water sprinkler system for dust & fumes suppression



Fume scrubber in the Western Portal

Water Treatment and Handling of Excavated Materials

- Water collected from the main tunnel will either by treated before discharge or temporarily stored for reuse.
- Valid effluent discharge licences are in force at the Western Portal and periodic water samplings are performed in accordance with the licence conditions.
- Excavated materials from adit blasting will be transported to the tunnel portal (inside the noise enclosure) for overnight storage in the Adit Spoil Basin which is fully covered by noise panels. Removal of excavated materials from the Adit Spoil Basin to the barge will only be done in the following morning.

6. Environmental Document Review

The following environmental documents under EIA Ordinance and related to the Project have been reviewed:

- (1) The EIA Report (Register No.: AEIAR-099/2006) prepared by Black & Veatch Co.
- (2) The Technical Notes on Supplementary Environmental Assessment prepared by Ove Arup in March 2007.
- (3) The Technical Notes to Support VEP Application, prepared by Ove Arup in October 2007.
- (4) The Environmental Permit (EP-272/2007/B) previously held by DSD and the Further Environmental Permit (FEP-01/272/2007/B) currently held by DNJV.

EIA Report

The following clauses are relevant the subject matter:

"2.4.5 Blasting is seen as the most suitable method of excavation for the adits due to the relative cost of alternative methods of construction. Blasting is not seen as a suitable method of excavation or the shafts due to the noise generated. Given the proximity of the intake shaft locations to sensitive receivers, blasting would need to be severely restricted to remain within the noise restrictions. Construction of shafts by drill and blast would also necessitate the shafts to be constructed larger than the 2.3 diameter required enabling spoil to be removed. This would consequently lead to slower progress

- and would also cause difficulties at many intake locations, where the working area is very restricted.
- 6.5.9(ii) No blasting shall be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted (unless prior permission of the Commissioner of Mines is obtained).
- 13.3.2 For the adit construction, drill and blast method will be adopted for the majority of the works. As the storage of explosives relates to the extent of the drill and blast component of works, it is important to review the rate of work, storage/delivery arrangements and the duration of the works. The blasting works will require about 30 months to complete. Based on the proposed construction programme and the blasting frequencies, there will be no requirement for overnight storage of explosive on site. The delivery of the explosive will be once per day. The delivery of explosives from Government Explosives Depots to the blasting site is controlled by the Explosives Delivery Unit of the Mines Division. Explosives are classified as Category I Dangerous Goods and use of explosives is controlled under the Dangerous Good Ordinance (Chapter 295). Since there will be no overnight storage of explosive on site, no Quantitative Risk Assessment is required for this study."

Technical Notes on Supplementary Environmental Assessment


Table 1-1: 'Summary of General Design Changes Since Approval of EIA' in page 2 of the Technical Notes states the following:

EIA Assumptions	Proposed Improvements	Justifications	Environmental Concerns
Delivery of	Delivery of explosive once	Additional delivery and	No impact on the EIA is anticipated since
explosives once	or twice per day	blasting will expedite the	there are still no overnight storage of
per day		progress of construction	explosive (see Section 12)

The proposed improvement in the Technical Notes does allow for 2 blasts per day and confirms no environmental concerns with such an improvement.

Technical Notes to Support VEP Application

The Technical Notes were prepared to address the impact of the proposed slight southward shift of the HKU1-W10-P5 Adit Junction due to the corresponding shift of the main tunnel alignment. However, there is no change in the HKU1-W10-P5 intake locations. The Notes do not mention anything about the blasting along the adits and in particular the HKU1-W10-P5 Adits.

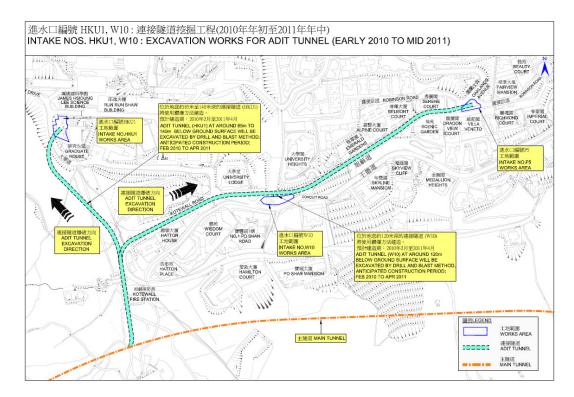

Environmental Permit & Further Environmental Permit

There are no General Conditions or Special Conditions in the EP and FEP for blasting works on Site.

7. Environmental Team Leader's Comments

The Environmental Team Leader (Dr. Priscilla Choy) expressed her professional opinion in her letter of 8 September 2010 that there is no specific restriction on 2 blasts per day including nighttime blasting work.

8. Conclusion

DNJV proposes 2 blasts per day in the West Adits – one in the daytime and the other one during nighttime. The review concludes that there is no restriction in all relevant environmental documents under the EIA Ordinance on 2 blasts per day (even nighttime blasting).

In addition, there is no adverse impact on the environment as a result of 2 blasts per day and nighttime blasting.

End of Text



Room 1710, Technology Park. 18 On Lai Street, Shatin, N.T., Hong Kong. Tel: (852) 2151 2083 Fax: (852) 3107 1388 Website: http://www.cinotech.com.hk E-mail : info@cinotech.com.hk

Our Ref: CCL/MA8001/Corres/Out/pc100908

Dragages-Nishimatsu Joint Venture 27/F., 625 King's Road North Point, Hong Kong

Attn: Mr. Daniel Altier

By Fax (2671 9300) & E-mail 8th September 2010

Dear Sir.

Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Proposal for 2 blasts in the West Adits

We refer to your message regarding the environmental aspects for proposing 2 blasts per day in the West Adits via e-mail on 3rd September 2010 for the captioned project.

After reviewing the relevant Environmental Permit, EIA Reports (including Technical Notes on Supplementary Environmental Assessment) for the captioned Contract, we would like to confirm that there is no specific restriction for 2 blasts per day including nighttime blasting for the Project. However, the EIA Report specifies that there will be no overnight storage of explosives for this

Although there is no restriction for 2 blasts per day, the following mitigation measures are recommended in the EIA Report for blasting operation:

No blasting shall be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted (unless prior permission of the Commissioner of Mines is obtained).

Hazard to Life

No overnight storage of explosives for this project.

If you have queries, please contact the undersigned at 2151 2089.

Yours faithfully,

Cinotech Consultants Limited

Dr. Priscilla Choy

Environmental Team Leader

Directors: Dr H F Chan (Managing Director), Dr Priscilla Choy A MEMBER OF CINOTECH GROUP