

# Dragages-Nishimatsu Joint Venture


**Contract No. DC/2007/10**

## **Design and Construction of Hong Kong West Drainage Tunnel**

Quarterly EM&A Report

April to June 2012

(version 2.0)

Certified By	 (Environmental Team Leader)
--------------	---

**REMARKS:**

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

**CINOTECH CONSULTANTS LTD**

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Tel: (852) 2151 2083 Fax: (852) 3107 1388

Email: [info@cinotech.com.hk](mailto:info@cinotech.com.hk)

## TABLE OF CONTENTS

	Page
<b>EXECUTIVE SUMMARY</b> .....	<b>1</b>
KEY ISSUES FOR THE COMING MONTH.....	9
<b>1. INTRODUCTION</b> .....	<b>10</b>
<b>2. PROJECT CHARACTERISTICS</b> .....	<b>11</b>
PROJECT ORGANIZATION AND CONTACTS OF KEY MANAGEMENT .....	11
CONSTRUCTION PROGRAMME AND SYNOPSIS OF WORK .....	12
<b>3. ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS</b> .....	<b>13</b>
MONITORING PARAMETERS AND MONITORING LOCATIONS .....	13
MONITORING METHODOLOGY AND CALIBRATION DETAILS .....	13
ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS).....	13
ENVIRONMENTAL MITIGATION MEASURES.....	13
<b>4. MONITORING RESULTS</b> .....	<b>14</b>
WEATHER CONDITIONS.....	14
AIR QUALITY .....	14
CONSTRUCTION AIRBORNE NOISE .....	14
CONSTRUCTION GROUND BORNE NOISE.....	15
WATER QUALITY .....	16
UNDERGROUND WATER LEVEL.....	16
<b>5. ENVIRONMENTAL AUDIT</b> .....	<b>18</b>
IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES .....	18
SITE AUDIT SUMMARY.....	18
EFFECTIVENESS OF MITIGATION MEASURES.....	20
STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING .....	20
STATUS OF WASTE MANAGEMENT .....	21
<b>6. NON-COMPLIANCE (EXCEEDANCES) OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS)</b> .....	<b>23</b>
SUMMARY OF EXCEEDANCES.....	23
CONSTRUCTION IMPACTS ON WATER QUALITY .....	23
REVIEW OF THE REASONS FOR AND THE IMPLICATIONS OF NON-COMPLIANCE .....	23
<b>7. ENVIRONMENTAL COMPLAINTS AND PROSECUTIONS</b> .....	<b>24</b>
<b>8. COMMENTS, CONCLUSIONS AND RECOMMENDATIONS</b> .....	<b>25</b>

## **LIST OF TABLE**

Table I	Summary Table for Non-compliance Recorded in the Reporting Quarter
Table II	Summary Table for Key Information in the Reporting Quarter
Table 2.1	Key Project Contacts
Table 4.1	Summary of Water Quality Exceedances in the Reporting Quarter
Table 4.2	Ground Water Level Monitoring Data in Reporting Quarter

## **LIST OF FIGURES**

Figure 1	Layout Plan of the Project
Figure 2	Organization Chart
Figure 3.1a	Locations of Air Quality and Construction Noise Monitoring Stations at Eastern Portal
Figure 3.1b	Locations of Air Quality and Construction Noise Monitoring Stations at Western Portal
Figure 3.1c	Locations of Construction Noise Monitoring Stations at Intake E7
Figure 3.1d	Locations of Construction Noise Monitoring Stations at Intake PFLR1
Figure 3.1e	Locations of Construction Noise Monitoring Stations at Intake W0
Figure 3.1f	Locations of Construction Noise Monitoring Stations at Intake RR1
Figure 3.1g	Locations of Construction Airborne and Ground borne Noise Monitoring Stations at Intake W5
Figure 3.1h	Locations of Construction Noise Monitoring Stations at Intake E5A
Figure 3.1i	Locations of Construction Noise Monitoring Stations at Intake THR2
Figure 3.1j	Locations of Construction Noise Monitoring Stations at Intake P5
Figure 3.1k	Locations of Construction Noise Monitoring Stations at Intake W8
Figure 3.1l	Locations of Construction Noise Monitoring Stations at Intake DG1
Figure 3.1m	Locations of Construction Noise Monitoring Stations at Intake MA14
Figure 3.1n	Locations of Construction Noise Monitoring Stations at Intake BR6
Figure 4.1a-b	Locations of Water Quality Monitoring Stations
Figure 4.2a-e	Location of Ground Water Level Monitoring Stations

## **LIST OF APPENDICES**

A	Construction Programme
B	Monitoring Requirements
C	Action and Limit Levels for Air Quality, Noise and Water Quality
D	Graphical Presentation of Air Quality Monitoring Results
E	Graphical Presentation of Noise Monitoring Results
F	Environmental Mitigation Implementation Schedule (EMIS)
G	Site Audit Summary
H	Summary Status of Environmental Licences and Permits
I	Waste Generated Quantity
J	Summary of Exceedances
K	Complaint Log
L	Graphical Presentation of Water Quality Monitoring Results

## EXECUTIVE SUMMARY

### *Introduction*

1. This is the 17<sup>th</sup> Quarterly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the “Drainage Improvement in Northern Hong Kong Island – Hong Kong West Drainage Tunnel” (the Project). This summary report presents EM&A works performed in the period between April to June 2012.
2. The construction activities undertaken in the reporting quarter were:
  - Outfall- end wall dismantling, tunnel intermediate wall works at Western Portal and River channel connection, Tunnel lining works, E&M works at Eastern Portal;
  - Dropshaft pilot hole and reaming at intake CR1;
  - Intake Excavation at Intake P5;
  - P5 dropshaft remedial measure works on-going;
  - HDC works completed at Intake W8;
  - Dropshaft in-situ lining at Intake W8 was completed;
  - Permanent Intake structure works at MBD2, PFLR1, HR1, W10, W3, W1, BR4, E5A, BR5, MA14, RR1, W0, M3, E7, MA17, W5, DG1 and W8;
  - Dropshaft lining works at DG1, MA17 and W5;
  - Permanent Adit Lining works completed at SM1, DG1, HR1, GL1, W0, BR4, W5, CR1, W1, W3, B2, MA14, BR5, P5, BR6, RR1 and MA17;
  - Permanent Adit Lining works on-going at W5, CR1, P5 and RR1;
  - Still Chamber Enlargement excavation at RR1 on-going;
  - Still Chamber lining works at W5, BR6, W3, E5B, MA17 and CR1;
  - Environmental impact monitoring;
  - Casting of dropshaft precast rings;
  - Permanent Leaky cable system installation on-going;
  - Tunnel temporary facilities dismantling on-going; and
  - East/West Main Tunnel connection lining.
  - Additional VO works at Intake SM1 and TP4;
  - Reinstatement works at Intakes B2, MA15, BR4, M3, PFLR1, MBD2, W3, W1, DG1, HR1, BR5 and BR6;
  - Handover back to employer Intake sites BR4, M3, TP5, TP789 and E5B;
  - Adit Tunnels remedial works on-going; and
  - Penstock and metal works on-going.

### *Environmental Monitoring Works*

3. Environmental monitoring for the Project was performed regularly as stipulated in the Updated EM&A Manual and the results were checked and reviewed. Site audits were conducted once per week. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
4. Proposal for Temporary Suspension of Water Quality Monitoring Western Portal was submitted on 15<sup>th</sup> September 2009 and approved by EPD on 30<sup>th</sup> October 2009. Marine water quality monitoring was temporary suspended starting from 31<sup>st</sup> October 2009 until there is marine-based construction activities resumed at the Western Portal.

Marine-based construction activity has resumed and marine water quality monitoring has resumed on 5<sup>th</sup> March 2012 accordingly.

5. In order to assess the effectiveness of the implementation of water quality mitigation measures at Western Portal, site inspections/audits were conducted at least twice per week at Western Portal starting from November 2009.
6. Summary of the non-compliance of the reporting month is tabulated in Table I.

**Table I Summary Table for Non-compliance Recorded in the Reporting Quarter**

Parameter	Number of Exceedances due to the Project		Action Taken	Results of Action Taken
	Action Level	Limit Level		
<b>Eastern Portal</b>				
<i>April 2012</i>				
1-hr TSP	0	0	N.A.	N.A.
24-hr TSP	0	0	N.A.	N.A.
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
1-hr TSP	0	0	N.A.	N.A.
24-hr TSP	0	0	N.A.	N.A.
Noise	1	0	N.A.	N.A.
<i>June 2012</i>				
1-hr TSP	0	0	N.A.	N.A.
24-hr TSP	0	0	N.A.	N.A.
Noise	3	0	N.A.	N.A.
<b>Western Portal</b>				
<i>April 2012</i>				
1-hr TSP	0	0	N.A.	N.A.
24-hr TSP	0	0	N.A.	N.A.
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
1-hr TSP	0	0	N.A.	N.A.
24-hr TSP	0	0	N.A.	N.A.
Noise	1	0	N.A.	N.A.
<i>June 2012</i>				
1-hr TSP	0	0	N.A.	N.A.
24-hr TSP	0	0	N.A.	N.A.
Noise	1	0	N.A.	N.A.
Water Quality	0	0	N.A.	N.A.
<b>Intake BR6</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake DG1</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.

<b>Intake E5A</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake E7</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake MA14</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake PFLR1</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake RR1</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake THR2</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.

<b>Intake W0</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake W5</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
Ground Borne Noise	0		N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
Ground Borne Noise	0		N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
Ground Borne Noise	0		N.A.	N.A.
<b>Intake W8</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.
<b>Intake P5</b>				
<i>April 2012</i>				
Noise	0	0	N.A.	N.A.
<i>May 2012</i>				
Noise	0	0	N.A.	N.A.
<i>June 2012</i>				
Noise	0	0	N.A.	N.A.

### Air Quality

#### *1-hour TSP Monitoring*

7. 1-hour TSP monitoring at 2 monitoring stations, AQ1 and AQ2, was conducted as scheduled in the reporting period. No Action/Limit Level exceedance was recorded for 1-hr TSP monitoring in the reporting quarter.

#### *24-hour TSP Monitoring*

8. 24-hr TSP monitoring at 2 monitoring station, AQ1 and AQ3, was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded for 24-hr TSP monitoring in the reporting quarter.



Construction Airborne Noise

9. Noise monitoring at 19 monitoring stations, at NC1, NC2, NC3, NC4, NC5, NC6, NC7, NC8, NC9, NC10, NC11, NC12, NC13, NC14, NC15a, NC16, NC17, NC18 and NC19 were conducted as schedule in the reporting period.

*Eastern Portal*

10. Four Action Level exceedances were recorded due to the complaints received on 14<sup>th</sup> May, 4<sup>th</sup> and 18<sup>th</sup> June 2012 during the reporting period.

*Western Portal*

11. Two Action Level exceedances were recorded due to the complaints received on 1<sup>st</sup> May and 2<sup>nd</sup> June 2012 during the reporting period.

*Intake BR6*

12. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake DG1*

13. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake E5A*

14. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake E7*

15. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake MA14*

16. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake PFLR1*

17. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake RR1*

18. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake THR2*

19. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake W0*

20. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake W5*

21. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake W8*

22. No Action/Limit Level exceedance was recorded during the reporting period.

*Intake P5*

23. No Action/Limit Level exceedance was recorded during the reporting period.

Construction Ground Borne Noise

24. Construction Ground Borne Noise Monitoring at GNC3 was temporary suspended since 7<sup>th</sup> May 2009 as the ISS EastPoint Property Management Ltd. received an instruction from the Incorporated Owners of Aegean Terrace that we are not permitted to conduct any noise monitoring inside Aegean Terrace for the Project.
25. According to the approved EIA report, noise monitoring should be performed at NSR1a (i.e. Crane Court) when TBM is operating through the tunnel section between points A and B). Therefore, Ground borne noise monitoring has been conducted at Crane Court (GNC4) since 3<sup>rd</sup> June 2009 during the TBM operated.
26. Ground borne noise monitoring at GNC1 – True Light Middle School, GNC2 – The Legend and GNC4 – Crane Court were completed by end of August 2009 accordingly.
27. Ground borne noise monitoring at GNC5 was completed by end of November 2009.
28. Ground borne noise monitoring at GNC6 – French International School was completed by end of June 2010.
29. Ground borne noise monitoring at GNC7 – Hong Villa was completed by the end of November 2011.
30. Ground borne noise monitoring was conducted at GNC8 – Raimondi College in the reporting period. No exceedance was recorded.

Water Quality

31. Water quality monitoring was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded.

***Environmental Licensing and Permitting***

32. Licenses/Permits granted to the Project include the Environmental Permit (EP) for the Project, An Environmental Permit No. EP-272/2007 was issued on 26 April 2007 and Environmental Permit No. EP-272/2007/A was issue on 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture.
33. Registration of Chemical Waste Producer (License: 5213-148-D2393-02 for Eastern Portal and No. 5213-172-D2393-01 for Western Portal).
34. Water Discharge License (License No.: EP860/W10/XY0175 for Area of Mount Butler Office, EP860/W10/XY0177 for Eastern Portal, EP820/W9/XT086 and WT00005864-2010 for Western Portal, EP860/W10/XY0183 for Intake W0, WT00003737-2009 for Intake MB16, WT00004126-2009 for Intake HKU1, WT00003738-2009 for THR2, WT00004270-2009 for PFLR1, WT00004806-2009 for Intake E7, WT00004808-2009 for MBD2, WT00004885-2009 for Intake RR1, WT00005135-2009 for Intake W10, WT00005357-2009 for Intake W5, WT00005374-2009 for Intake P5, WT00005376-2009 for Intake TP4, WT00005588-2009 for Intake TP5, WT00005643-2009 for Intake

E5A, WT00005754-2010 for Intake W8, WT00005954-2010 for Intake TP789, WT00005915-2010 for Intake E5B, WT00006102-2010 for Intake M3, WT00006415-2010 for Intake MA15, WT00006420-2010 for Intake MA17, WT00006428-2010 for Intake BR6, WT00006609-2010 for Intake HR1, WT00006559-2010 for Intake CR1, WT00006929-2010 for Intake W1, WT00006418-2010 for Intake MA14, WT00006865-2010 for Intake BR5, WT00007039-2010 for Intake DG1, WT00007042-2010 for Intake W3, WT00007043-2010 for Intake GL1, WT00007130-2010 for Intake BR4, WT00007139-2010 for Intake BR6 – SMH17 and WT00007319-2010 for Intake B2 ).

- 35. Construction Noise Permit (License No.: GW-RS0969-11 and GW-RS0308-12 for Eastern Portal, GW-RS1036-11 and GW-RS0419-12 for Western Portal, GW-RS0358-12 for concreting works at Western Portal, GW-RS0222-12 for Eastern Adits, GW-RS0077-12 for Intake PFLR1, GW-RS1050-11 and GW-RS0510-12 for Intake W3, GW-RS1008-11 and GW-RS0465-12 for Intake BR4, GW-RS1009-11 and GW-RS0457-12 for Intake W1, GW-RS0104-12 for tunnel and adits section under Central-Western District.)

**Key Information in the Reporting Quarter**

- 36. Summary of key information in the reporting quarter is tabulated in Table II.

**Table II Summary Table for Key Information in the Reporting Quarter**

Event	Event Details		Action Taken	Status	Remark
	Number	Nature			
Complaint received (April 2012)	1	Construction noise at Intake MA17	Investigation completed	Closed	---
Complaint received (May 2012)	1	Construction noise at Eastern Portal	Investigation completed	Closed	---
	1	Construction noise at Western Portal			
Complaint received (June 2012)	3	Construction noise at Eastern Portal	Investigation completed	Closed	---
	1	Construction noise at Western Portal			
Changes to the assumptions and key construction / operation activities recorded	0	---	N.A.	N.A.	---
Notifications of any summons & prosecutions received	0	---	N.A.	N.A.	---

**Complaints and Prosecutions**

37. 7 environmental complaints were received and investigated during the reporting quarter.
38. No warning, summon and notification of successful prosecution was received in the reporting period.

### ***Future Key Issues***

#### **Key Issues for the Coming Month**

39. Key environmental issues at Eastern and Western Portals, Intake MA16, MBD2, E5A, E5B, E7, PFLR1, RR1, THR2, W0, W5, P5, M3, TP4, TP5, TP789, HKU1, W10, W3, W8, MA15, MA17, GL1, HR1, W1, DG1, CR1, BR4, BR5, GL1, MA14 and BR6 in the coming month include:
- Noise from operation of the equipment, especially for rock-breaking activities, piling works and machinery on-site;
  - Dust generation from stockpiles of dusty materials, excavation works and rock breaking activities;
  - Runoff from exposed slope;
  - Wastewater and runoff discharge from site;
  - Regular removal of silt, mud and sand along u-channels and sedimentation tanks;
  - Review and implementation of temporary drainage system for the surface runoff;
  - Proper storage of construction materials on site;
  - Storage of chemicals/fuel and chemical waste/waste oil on site;
  - Watering for rock breaking activity, soil nailing and on haul road;
  - Accumulation of general and construction waste on site.

## 1. INTRODUCTION

- 1.1 The Project “Drainage Improvement in Northern Hong Kong Island – Hong Kong West Drainage Tunnel” involves the construction of a drainage tunnel deep into the ground in Mid-levels of the Northern Hong Kong Island from Tai Hang to Pokfulam to intercept and convey the stormwater from the upper catchment directly to the sea near Cyberport. The Drainage tunnel alignment starts from the Eastern Portal near Haw Par Mansion in Tai Hang and ends at the Western Portal located to the north of Cyberport running underneath the Pok Fu Lam, Tai Tam, Aberdeen and Lung Fu Shan Country Parks. The underground main drainage tunnel is 6.25m-7.25m in diameter and about 11km long. Two portals and a series of connecting adits and drop shafts are also been constructed. The layout plan of the Project is shown in **Figure 1**.
- 1.2 The Environmental Impact Assessment (EIA) Report for the Project was approved on 7 April 2006 under the Environmental Impact Assessment Ordinance (EIAO). An Environmental Permit (EP-272/2007) for the works was also granted on 26 April 2007. A varied Environmental Permit (EP) (EP-272/2007/A) was issued in 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture. Environmental Monitoring and Audit (EM&A) Manual for the Project was also included as part of the EIA reports in the register. An updated EM&A Manual has been issued on 7 May 2008.
- 1.3 Drainage Services Department awarded the construction of the Project to Dragages-Nishimatsu Joint Venture (hereinafter called “the Contractor”). The construction works commenced on 30 November 2007 and are scheduled to be completed by 2012.
- 1.4 Cinotech Consultants Limited (Cinotech) was commissioned by the Contractor to undertake the Environmental Team (ET) Services for the Project. All environmental and audit works were conducted by Cinotech and the laboratory testing works were conducted by a HOKLAS laboratory, Wellab Limited. This is the 17<sup>th</sup> quarterly EM&A report summarizing the EM&A works for the Project in the period between April to June 2012.

## 2. PROJECT CHARACTERISTICS

### Project Organization and Contacts of Key Management

- 2.1 Different parties with different levels of involvement in the project organization include:
- Project Proponent – Drainage Services Department (DSD).
  - The Supervising Officer or Supervising Officer's Representative (SO or SOR) – Ove Arup & Partners (ARUP).
  - Environmental Team (ET) – Cinotech Consultants Limited (CCL).
  - Independent Environmental Checker (IEC) – Allied Environmental Consultants Limited (AEC).
  - Contractor - Dragages-Nishimatsu Joint Venture (DNJV).
- 2.2 The responsibilities of respective parties are detailed in Sections 1.14 to 1.28 of the Updated EM&A Manual of the Project. The project organization chart is presented in **Figure 2**.
- 2.3 The key contacts of the Project are shown in Table 2.1.

**Table 2.1 Key Project Contacts**

Party	Role	Name	Position	Phone No.	Fax No.
DNJV	Permit Holder	Mr. ALTIER Daniel	Project Manager	2671 7333	2671 9300
		Mr. UETAKE H.	Deputy Project Manager		
ARUP	Supervising Officer	Mr. Jackson Wong	CRE	6117 6639	2436 1012
		Ms. Angela Yan	RE	3961 5206	
Cinotech	Environmental Team	Dr. Priscilla Choy	ET Leader	2151 2089	3107 1388
		Ms. Ivy Tam	Project Coordinator and Audit Team Leader	2151 2090	
		Mr. Henry Leung	Monitoring Team Leader	2151 2087	
AEC	Independent Environmental Checker	Ms. Grace Kwok	Independent Environmental Checker	2815 7028	2815 5399
DNJV	Contractor	Ms. Ashley Au	Environmental Officer	3476 0754	2671 9300

### Construction Programme and Synopsis of Work

2.4 The construction programme is presented in **Appendix A**.

### **3. ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS**

#### **Monitoring Parameters and Monitoring Locations**

- 3.1 The EM&A Manual designates locations for the ET to monitor environmental impacts in terms of air quality, noise and water quality due to the Project. When alternative monitoring locations are proposed, the criteria listed in Section 2.4.3 of the updated EM&A Manual shall be followed and the updated monitoring locations shall be approved by ER and agreed with IEC. The Project area and monitoring locations are depicted in **Figures 3a-n and 4a-e**. **Appendix B** gives details of monitoring requirements.

#### **Monitoring Methodology and Calibration Details**

- 3.2 Monitoring works/equipments were conducted/calibrated regularly in accordance with the EM&A Manual. Copies of calibration certificates are attached in the appendices of the Monthly Reports.

#### **Environmental Quality Performance Limits (Action and Limit Levels)**

- 3.3 The environmental quality performance limits, i.e. Action and Limit Levels were derived from the baseline monitoring results. Should the measured environmental quality parameters exceed the Action/Limit Levels, the respective action plans would be implemented. The Action/Limit Levels for each environmental parameter are given in **Appendix C**.

#### **Environmental Mitigation Measures**

- 3.4 Relevant mitigation measures as recommended in the project EIA report have been stipulated in the EM&A Manual for the Contractor to implement. A list of mitigation measures is given in **Appendix F**.



## 4. MONITORING RESULTS

### Weather Conditions

- 4.1 The weather during monitoring sessions was mainly sunny and cloudy. The weather conditions for each individual monitoring session were presented in the field record sheets.

### Air Quality

#### *1-hour TSP Monitoring*

- 4.2 1-hour TSP monitoring at 2 monitoring stations, AQ1 and AQ2, was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded for 1-hr TSP monitoring in the reporting quarter.

#### *24-hour TSP Monitoring*

- 4.3 24-hr TSP monitoring at 2 monitoring station, AQ1 and AQ3 was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded for 24-hr TSP monitoring in the reporting quarter.
- 4.4 The graphical presentations of the air quality monitoring results are shown in **Appendix D**.

### Construction Airborne Noise

- 4.5 Noise monitoring at 19 monitoring stations, NC1, NC2, NC3, NC4, NC5, NC6, NC7, NC8, NC9, NC10, NC11, NC12, NC13, NC14, NC15a, NC16, NC17, NC18 and NC19 were conducted as schedule in the reporting period.

#### *Eastern Portal*

- 4.6 Four Action Level exceedances were recorded due to the complaints received on 14<sup>th</sup> May, 4<sup>th</sup> and 18<sup>th</sup> June 2012 during the reporting period.

#### *Western Portal*

- 4.7 Two Action Level exceedances were recorded due to the complaints received on 1<sup>st</sup> May and 2<sup>nd</sup> June 2012 during the reporting period.

#### *Intake BR6*

- 4.8 No Action/Limit Level exceedance was recorded during the reporting period.

#### *Intake DGI*

- 4.9 No Action/Limit Level exceedance was recorded during the reporting period.

#### *Intake E5A*

- 4.10 No Action/Limit Level exceedance was recorded during the reporting period.

#### *Intake E7*

- 4.11 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake MA14*

4.12 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake PFLR1*

4.13 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake RR1*

4.14 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake THR2*

4.15 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake W0*

4.16 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake W5*

4.17 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake W8*

4.18 No Action/Limit Level exceedance was recorded during the reporting period.

*Intake P5*

4.19 No Action/Limit Level exceedance was recorded during the reporting period.

**Construction Ground Borne Noise**

4.20 Construction Ground Borne Noise Monitoring at GNC3 was temporary suspended since 7<sup>th</sup> May 2009 as the ISS EastPoint Property Management Ltd. received an instruction from the Incorporated Owners of Aegean Terrace that we are not permitted to conduct any noise monitoring inside Aegean Terrace for the Project.

4.21 According to the approved EIA report, noise monitoring should be performed at NSR1a (i.e. Crane Court) when TBM is operating through the tunnel section between points A and B). Therefore, Ground borne noise monitoring has been conducted at Crane Court (GNC4) since 3<sup>rd</sup> June 2009 during the TBM operated.

4.22 Ground borne noise monitoring at GNC1 – True Light Middle School, GNC2 – The Legend and GNC4 – Crane Court were completed by end of August 2009 accordingly.

4.23 Ground borne noise monitoring at GNC5 was completed by end of November 2009.

4.24 Ground borne noise monitoring at GNC6 – French International School was completed by end of June 2010.

4.25 Ground borne noise monitoring was conducted at GNC7 – Hong Villa was completed by the end of November 2011.

4.26 Ground borne noise monitoring was conducted at GNC8 – Raimondi College in the reporting quarter. No exceedance was recorded.

**Water Quality**

- 4.27 Water quality monitoring was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded.
- 4.28 The summary of exceedances for each water quality parameters are provided in Table 4.1.

**Table 4.1 Summary of Water Quality Exceedances in the Reporting Quarter**

Water Quality	No. of Exceedances		Action Taken	Results of Action Taken	Remarks
	Action Level	Limit Level			
<i>April 2012</i>					
DO (Surface and Middle)	0	0	N/A	N/A	N/A
DO(Bottom)	0	0			
Turbidity	0	0			
SS	0	0			
<i>May 2012</i>					
DO (Surface and Middle)	0	0	N/A	N/A	N/A
DO(Bottom)	0	0			
Turbidity	0	0			
SS	0	0			
<i>June 2012</i>					
DO (Surface and Middle)	0	0	N/A	N/A	N/A
DO(Bottom)	0	0			
Turbidity	0	0			
SS	0	0			

- 4.29 No Action/Limit Level exceedance was recorded.
- 4.30 The graphical presentations of the water quality monitoring results are shown in **Appendix L**.

**Underground water level**

- 4.31 Ground water levels were measured once per month during the construction phase in order to ensure the water levels at those intakes near to the natural stream courses and thus on the surrounding habitats will not be significantly affected.

- 4.32 Locations of designated ground water level (borehole with piezometer) monitoring station UC1 at Eastern Portal has been changed to ADH48 which was verified by IEC on 5<sup>th</sup> June 2008. The updated ground water level monitoring stations, TP789\_DH2, TP5\_DH2, THR2\_DH7 and PFLR1\_DH2 were also verified by IEC on 19<sup>th</sup> June 2010. Monitoring data are shown in Table 4.2.

**Table 4.2 Ground Water Level Monitoring Data in Reporting Quarter**

Date	Water Level (from ground)/m
<b>Location: ADH48 (Eastern Portal)</b>	
19 April 2012	7.72
16 May 2012	7.65
14 June 2012	7.54
<b>Location: TP789_DH2</b>	
14 April 2012	14.60
12 May 2012	14.60
14 June 2012	14.60
<b>Location: TP5_DH2</b>	
14 April 2012	0.96
12 May 2012	0.85
14 June 2012	0.86
<b>Location: THR2_DH7</b>	
14 April 2012	3.00
15 May 2012	3.00
14 June 2012	3.00
<b>Location:PFLR1_DH2</b>	
14 April 2012	11.65
12 May 2012	11.60
14 June 2012	11.60

## 5. ENVIRONMENTAL AUDIT

### Implementation Status of Environmental Mitigation Measures

- 5.1 The implementation status of environmental mitigation measures (EMIS) is given in **Appendix F**.

### Site Audit Summary

- 5.2 During site inspections in the reporting period, no non-conformance was identified. The observations and recommendations made during the reporting period are summarized in **Appendix G**.
- 5.3 The major deficiencies identified by ET in the reporting quarter are summarized as follow:

#### *Water Quality*

- Desilting facilities should be provided to wastewater before entering the public channel at EP and W3.
- Mud water was observed discharged into public channel at MBD2. The Contractor was reminded to provide desilting facilities before discharging.
- Cover the exposed slope at Eastern Portal to prevent flushing during rainy season.
- Provide sand bag bunding at intake E5A.
- Silty water was observed discharged into natural stream directly at W1. The Contractor was reminded to provide desilting facilities to silty water.
- The gullies at M3 were observed blocked by construction material. The Contractor is reminded to maintain the drainage properly.
- The wheel-washing bay and the drainage were observed deposited by concrete at HR1. The Contractor should ensure that they function properly.
- The drainage was observed blocked by concrete at HR1.
- Mud water was observed deposited out of the site boundary on the public road at Intake E5A.
- Muddy water was observed directly pumping out to the existing drain at Eastern Portal. The Contractor was reminded to provide desilting facilities to treat the silty water.
- Muddy water was observed almost overflow at Intake HR1. The Contractor was reminded to provide water diversion for the runoff discharge at the upstream.
- Muddy water was observed discharging to the public area at Intake HR1. The Contractor was reminded to provide water quality mitigation measures (e.g. Cover the exposed slope, sand bag protection, etc) properly.

*Air Quality*

- Dust generation was observed during the rock breaking works at WP. The Contractor was reminded to provide dust mitigation measures properly.
- Mud trail was observed at the site exit of Eastern Portal. The Contractor was reminded to provide wheel washing for the vehicle before leaving the site.
- Grey smoke emitted from the concreting machine at Intake W5. The Contractor was reminded to check and repair the plant regularly.

*Waste/Chemical Management*

- Stockpile of rock and sediment was observed at the public road at Intake M3. The Contractor was reminded to clear it as soon as possible.
- Construction waste and debris are observed deposited in the stream near Intake MA14. The Contractor should ensure minimum impact is brought to local ecology.

5.4 The major deficiencies identified by IEC in the reporting quarter are summarized as follow:

25<sup>th</sup> April 2012Follow up Observation:

- Stagnant water inside the desilting tank at intake W1 had been removed by the Contractor. (Closed)
- Stagnant water at intake BR4 had been removed by the Contractor. (Closed)

New Observations:

- Oil drums were observed without proper drip tray and label at Eastern Portal. The Contractor was requested to provide proper label and drip tray for oil drum.
- Overflow from desilting tank was observed at intake E5A. The Contractor was requested to clear the deposits inside the tank and ensure the capacity of the tank is enough for treating the wastewater.
- Overflow from surface channel was observed at Western Portal. The Contractor was requested to regularly clean up the surface channel to prevent blockage.
- Stagnant water was observed on the H-beam at intake E7. The Contractor was requested to clear the stagnant water.

Reminder:

The Contractor was reminded to provide sandbags bunding at intake E5A to prevent site water from entering public area.

1<sup>st</sup> June 2012Follow up Observation:

- The oil drum at Eastern Portal had been removed by the Contractor. (Closed)
- The Contractor has cleared the deposits inside the desilting tank at Intake E5A and no overflow was observed during site audit. (Closed)
- The surface channel at Western Portal has been cleaned by the Contractor and no overflow was observed. (Closed)

- Stagnant water on H-beams was partially cleared at Intake E7. The Contractor was requested to clear the stagnant water on all H-beams within the site. (Outstanding)

#### New Observations:

- It is suspected that surface runoff may flow underneath the water-filled barriers and enter public area during rainy event at Intake E5A. The Contractor was requested to provide sandbags bunding along the bottom of the water-filled barriers.'

#### Reminder:

- The Contractor was reminded to cover the disused desilting tank at Intake E5A to prevent accumulation of stagnant water.
- The Contractor was reminded to regularly clear the C&D waste inside the waste collection skip at Intake E7.

28<sup>th</sup> June 2012

#### Follow up Observation:

- Stagnant water on H-beam at Intake E7 had been cleared by the Contractor. (Closed)
- Sandbags were provided at Intake E5A to prevent site water from entering the public area. (Closed)

#### New Observations:

- Drip tray is missing for the fuel drums inside the tunnel of Eastern Portal. The Contractor is requested to provide proper drip tray for the fuel drums.
- No label was provided for the oil containers at Eastern Portal. The Contractor was requested to provide proper label for every oil container.
- Tyre marks were observed on Tai Hang Road outside the site entrance of Eastern Portal. The Contractor was requested to ensure the wheels of site vehicles are washed before leaving site and the tyre marks shall be cleared.

#### Reminder:

The Contractor was requested to improve housekeeping practices at Eastern Portal.

### **Effectiveness of Mitigation Measures**

- 5.5 The mitigation measures recommended in the EIA report and required by the EP are considered effective in minimizing environmental impacts. The Contractor has implemented the recommended mitigation measures except those mitigation measures not applicable at this stage, it is however considered that the Contractor could put greater efforts into proper implementation of these measures, especially for the construction of noise enclosure and use of quiet PME, to ensure their intended effects are fully achieved.

### **Status of Environmental Licensing and Permitting**

- 5.6 Licenses/Permits granted to the Project include the Environmental Permit (EP) for the Project, An Environmental Permit No. EP-272/2007 was issued on 26 April 2007 and Environmental Permit No. EP-272/2007/A was issue on 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was

issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture.

- 5.7 Registration of Chemical Waste Producer (License: 5213-148-D2393-02 for Eastern Portal and No. 5213-172-D2393-01 for Western Portal).
- 5.8 Water Discharge License (License No.: EP860/W10/XY0175 for Area of Mount Butler Office, EP860/W10/XY0177 for Eastern Portal, EP820/W9/XT086 and WT00005864-2010 for Western Portal, EP860/W10/XY0183 for Intake W0, WT00003737-2009 for Intake MB16, WT00004126-2009 for Intake HKU1, WT00003738-2009 for THR2, WT00004270-2009 for PFLR1, WT00004806-2009 for Intake E7, WT00004808-2009 for MBD2, WT00004885-2009 for Intake RR1, WT00005135-2009 for Intake W10, WT00005357-2009 for Intake W5, WT00005374-2009 for Intake P5, WT00005376-2009 for Intake TP4, WT00005588-2009 for Intake TP5, WT00005643-2009 for Intake E5A, WT00005754-2010 for Intake W8, WT00005954-2010 for Intake TP789, WT00005915-2010 for Intake E5B, WT00006102-2010 for Intake M3, WT00006415-2010 for Intake MA15, WT00006420-2010 for Intake MA17, WT00006428-2010 for Intake BR6, WT00006609-2010 for Intake HR1, WT00006559-2010 for Intake CR1, WT00006929-2010 for Intake W1, WT00006418-2010 for Intake MA14, WT00006865-2010 for Intake BR5, WT00007039-2010 for Intake DG1, WT00007042-2010 for Intake W3, WT00007043-2010 for Intake GL1, WT00007130-2010 for Intake BR4, WT00007139-2010 for Intake BR6 – SMH17 and WT00007319-2010 for Intake B2 ).
- 5.9 Construction Noise Permit (License No.: GW-RS0969-11 and GW-RS0308-12 for Eastern Portal, GW-RS1036-11 and GW-RS0419-12 for Western Portal, GW-RS0358-12 for concreting works at Western Portal, GW-RS0222-12 for Eastern Adits, GW-RS0077-12 for Intake PFLR1, GW-RS1050-11 and GW-RS0510-12 for Intake W3, GW-RS1008-11 and GW-RS0465-12 for Intake BR4, GW-RS1009-11 and GW-RS0457-12 for Intake W1, GW-RS0104-12 for tunnel and adits section under Central-Western District.)
- 5.10 The status of these licenses and permits obtained for the Project is summarized in **Appendix H**.

### **Status of Waste Management**

- 5.11 During this reporting quarter, a total 203 nos. of dump trucks of waste were delivered to SENT, 1 trips of C&D waste were delivered to Tuen Mun Fill Bank. 1492 and 11 trips of C&D waste were delivered to Chai Wan Public Barging Point and TKO Fill Bank respectively. Both the trip ticket system and chit accounting system for disposal of waste were operating smoothly to date. 7 trucks overloading case was recorded during this reporting period (All cases were within the 105% allowable buffer weight). No disposal of inert C&D material to public sorting facilities and no dump truck without cover were reported from CEDD. In respect of the dump truck cover, DNJV keeps on take record photos and inspection to ensure that all dump trucks have fully covered the skip before leaving the site.
- 5.12 The rock materials from the Eastern Portal and Western Portal were received by the alternative disposal sites at ZhongShan. Some of the tunnel spoils from adits were also received by Nishimatsu Construction Co. Ltd. Construction Site of MTR SIL(E)



Contract 902 which was started from 30<sup>th</sup> June 2011.

- 5.13 The monthly summary of waste flow table for April to June 2012 are provided in **Appendix I**.

## 6. NON-COMPLIANCE (EXCEEDANCES) OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS)

### Summary of Exceedances

- 6.1 Environmental monitoring works were performed in the reporting period and all monitoring results were checked and reviewed. A summary of exceedances is attached in **Appendix J**. The details of each exceedance were attached in the Monthly Reports.

#### *Air Quality*

- 6.2 No Action/ Limit Level exceedance was recorded in the reporting quarter.

#### *Construction Airborne Noise*

##### *Eastern Portal*

- 6.3 Four Action Level exceedances were recorded due to the complaints received on 14<sup>th</sup> May, 4<sup>th</sup> and 18<sup>th</sup> June 2012 during the reporting period.

##### *Western Portal*

- 6.4 Two Action Level exceedances were recorded due to the complaints received on 1<sup>st</sup> May and 2<sup>nd</sup> June 2012 during the reporting period.

#### *Construction Ground Borne Noise*

- 6.5 No Action/ Limit Level exceedance was recorded in the reporting quarter.

### Construction Impacts on Water Quality

- 6.6 All marine water quality monitoring was conducted as scheduled in the reporting month. No Action/Limit Level exceedance was recorded.

### Review of the Reasons for and the Implications of Non-compliance

- 6.7 There was no non-compliance from the site audits in the reporting quarter. The observations and recommendations made in each individual site audit session were attached in the Monthly Reports.

**7. ENVIRONMENTAL COMPLAINTS AND PROSECUTIONS**

- 7.1 7 environmental complaints, including 1 for April 2012, 2 for May 2012 and 4 for June 2012 were received and investigated during the reporting quarter. The updated Complaint Log is attached in **Appendix K**.
- 7.2 No warning, summon and notification of successful prosecution was received in the reporting period.
- 7.3 There were a total of 129 project related environmental complaints, no warnings, summons and successful prosecutions received since the commencement of the Project.

## 8. COMMENTS, CONCLUSIONS AND RECOMMENDATIONS

8.1 The major construction activities in the coming month include:

- Arch tunnel structures at Western Portal, E&M and Reinstatement works at Eastern Portal;
- Permanent Adit lining works at W5, P5, CR1 and RR1;
- Stilling chamber lining works at RR1 and P5;
- Permanent Intake Structure Construction at Intake W10, RR1, W5, E7, MA17 and W8;
- Excavation of intake structure at Intakes P5 and CR1;
- Penstock and metal works at Intakes BR5, HR1, RR1 and E7;
- Intake reinstatement works at Intakes BR5, HR1, W0, W1, W3, DG1, HR1 and PFLR1;
- Permanent Leaky cable installation work & Testing and commissioning on-going;
- Temporary Tunnel facilities dismantling and cleaning on-going; and
- Dropshaft lining at CR1.

8.2 According to the environmental audit performed in the reporting period, the following recommendations were made:

### *Air Quality Impact*

- To prohibit any open burning on site.
- To regularly maintain the machinery and vehicles on site.
- To implement dust suppression measures on all haul roads, stockpiles, dry surfaces and excavation works.
- To provide hoarding

### *Noise Impact*

- To inspect the noise sources inside the site.
- To space out noisy equipment and position the equipment as far away as possible from sensitive receivers.
- To provide temporary noise barriers for operations of noisy equipment near the noise sensitive receivers in an appropriate location.

### *Water Impact*

- To prevent any surface runoff discharge into any stream course.
- To review and implement temporary drainage system.
- To identify any wastewater discharges from site.
- To ensure properly maintenance for de-silting facilities.
- To clear the silt and sediment in the sedimentation tanks.
- To review the capacity of de-silting facilities for discharge.
- To divert all the water generated from construction site to de-silting facilities with

enough handling capacity before discharge.

- To avoid accumulation of stagnant and ponding water on site.

*Waste/Chemical Management*

- To check for any accumulation of waste materials or rubbish on site.
- To ensure the performance of sorting of C&D materials at source (during generation);
- To carry out inspection of dump truck at site exit to ensure inert and non-inert C&D materials are properly segregated before removing off site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the site.
- To avoid improper handling or storage of oil drum on site.


---

---

## FIGURES


---

---

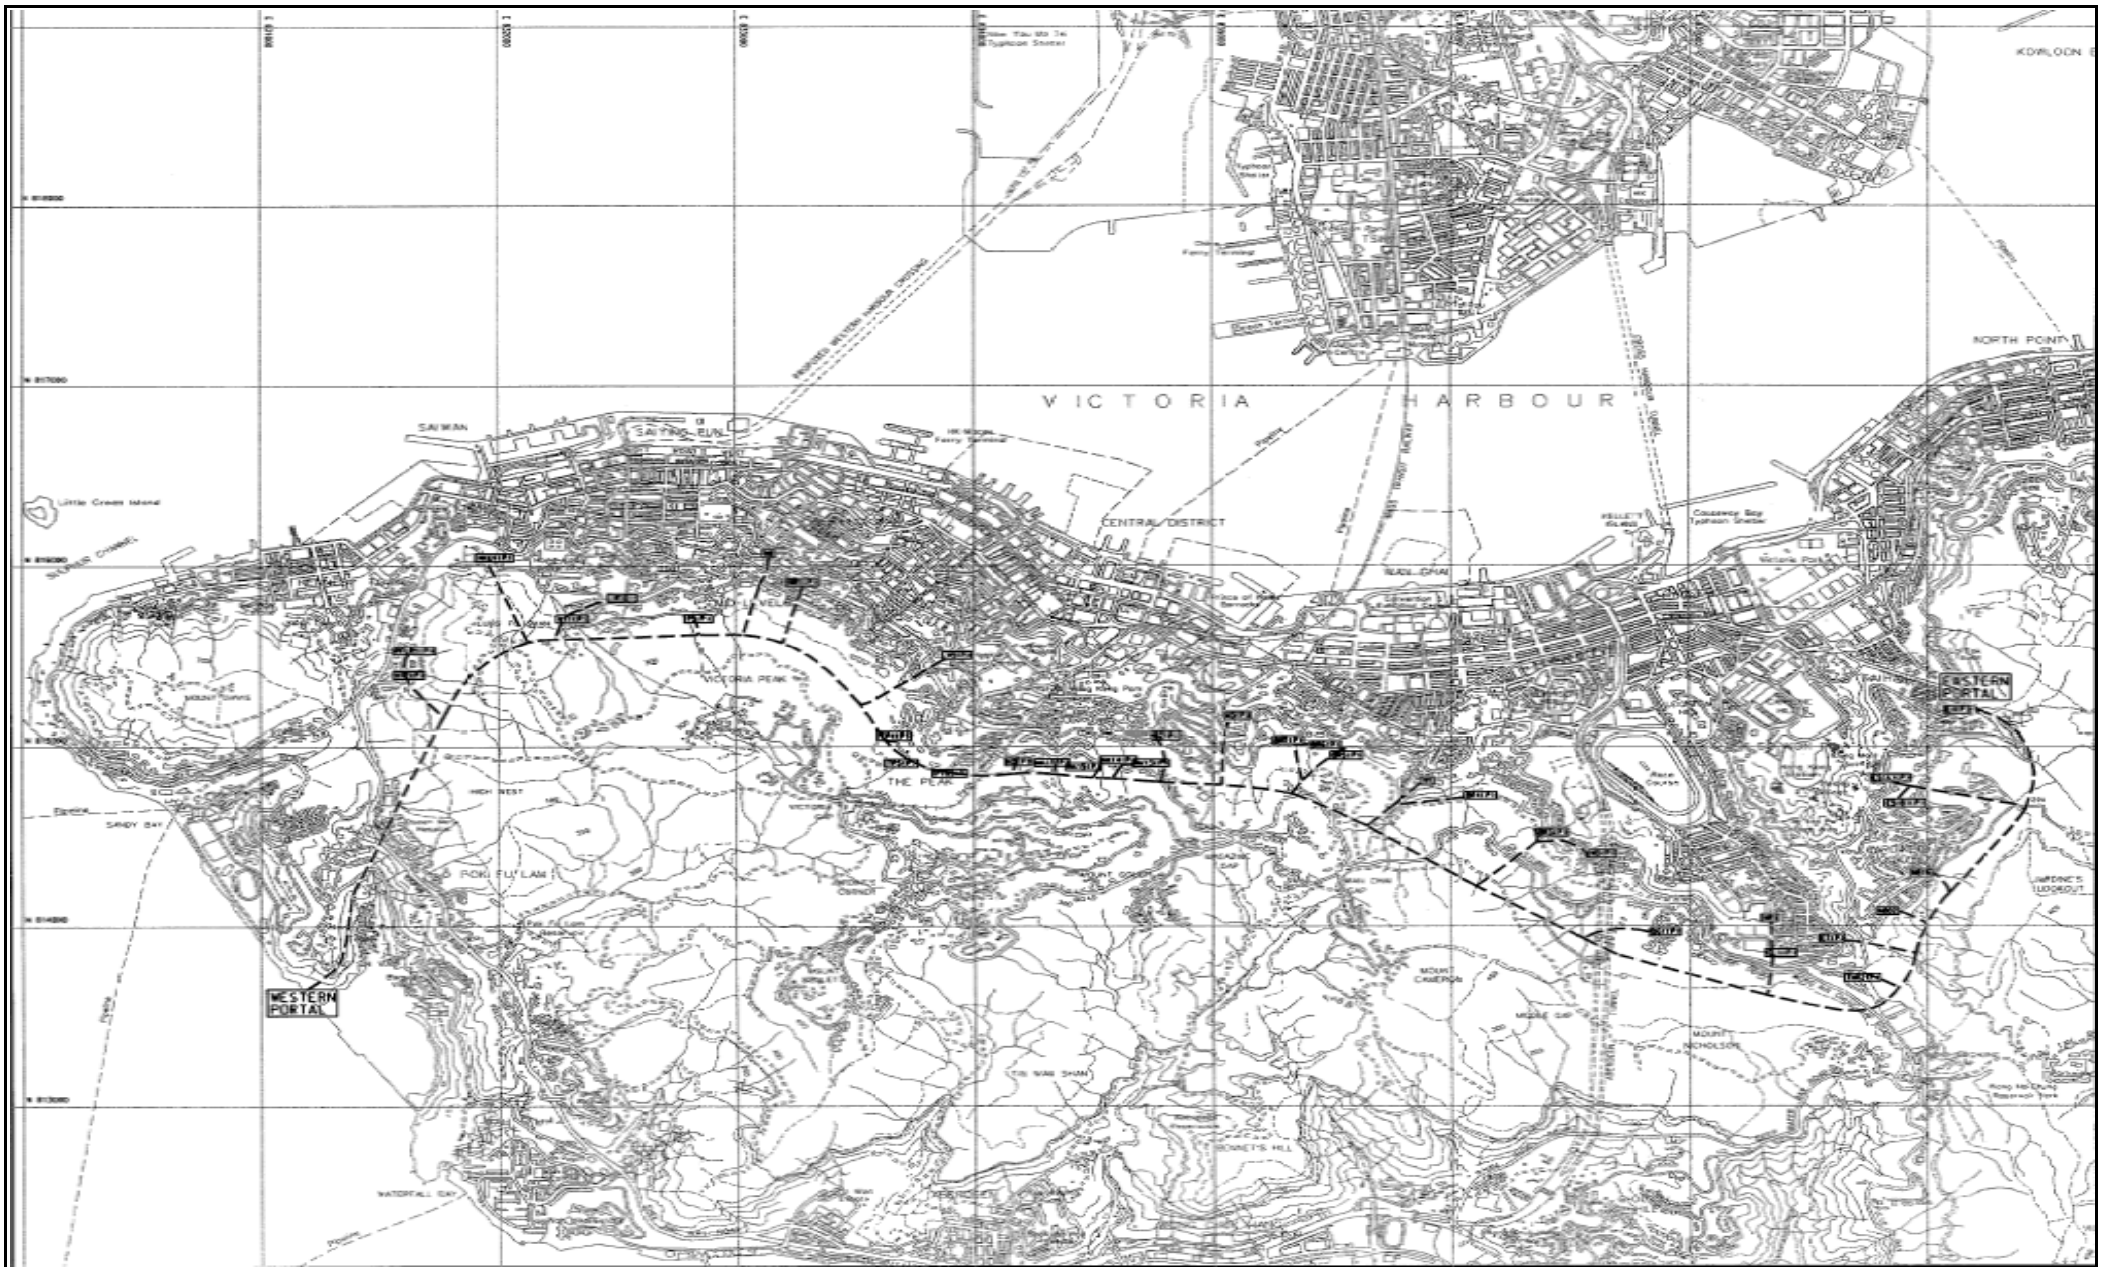


Title	Contract No. DC/2007/10		Scale	Project
	Design and Construction of Hong Kong West Drainage Tunnel		N.T.S	No. MA8001
	Site Layout Plan		Date	Figure
			Apr-08	1.1



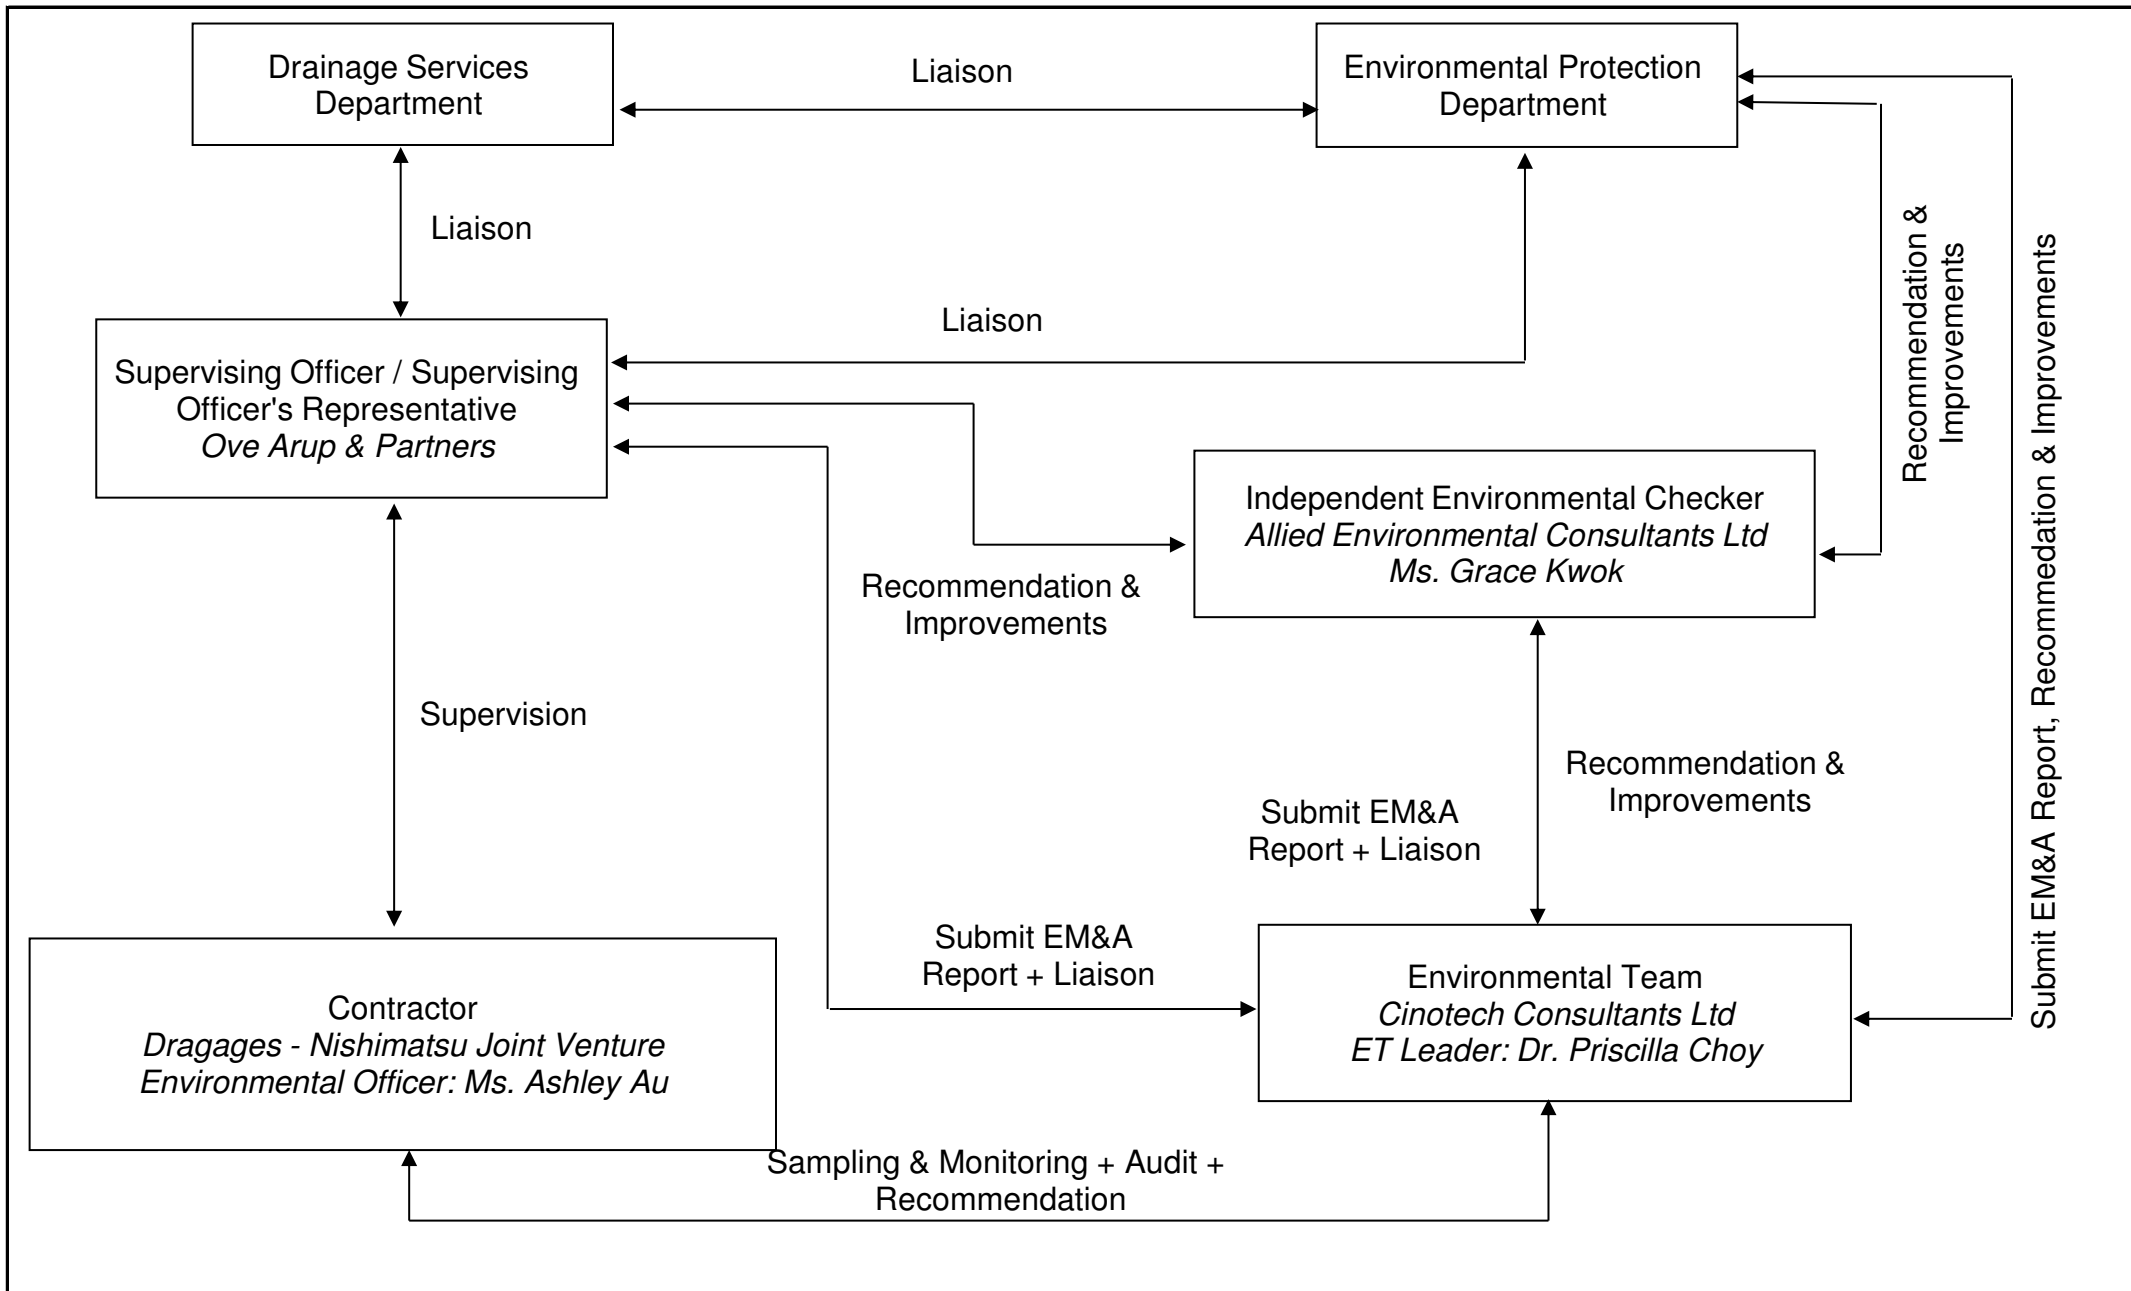

Title	Contract No. DC/2007/10	Scale	N.T.S	Project No.	MA8001	CINOTECH
	Design and Construction of Hong Kong West Drainage Tunnel	Date	Apr 12	Figure	2.1	
Organization Chart						



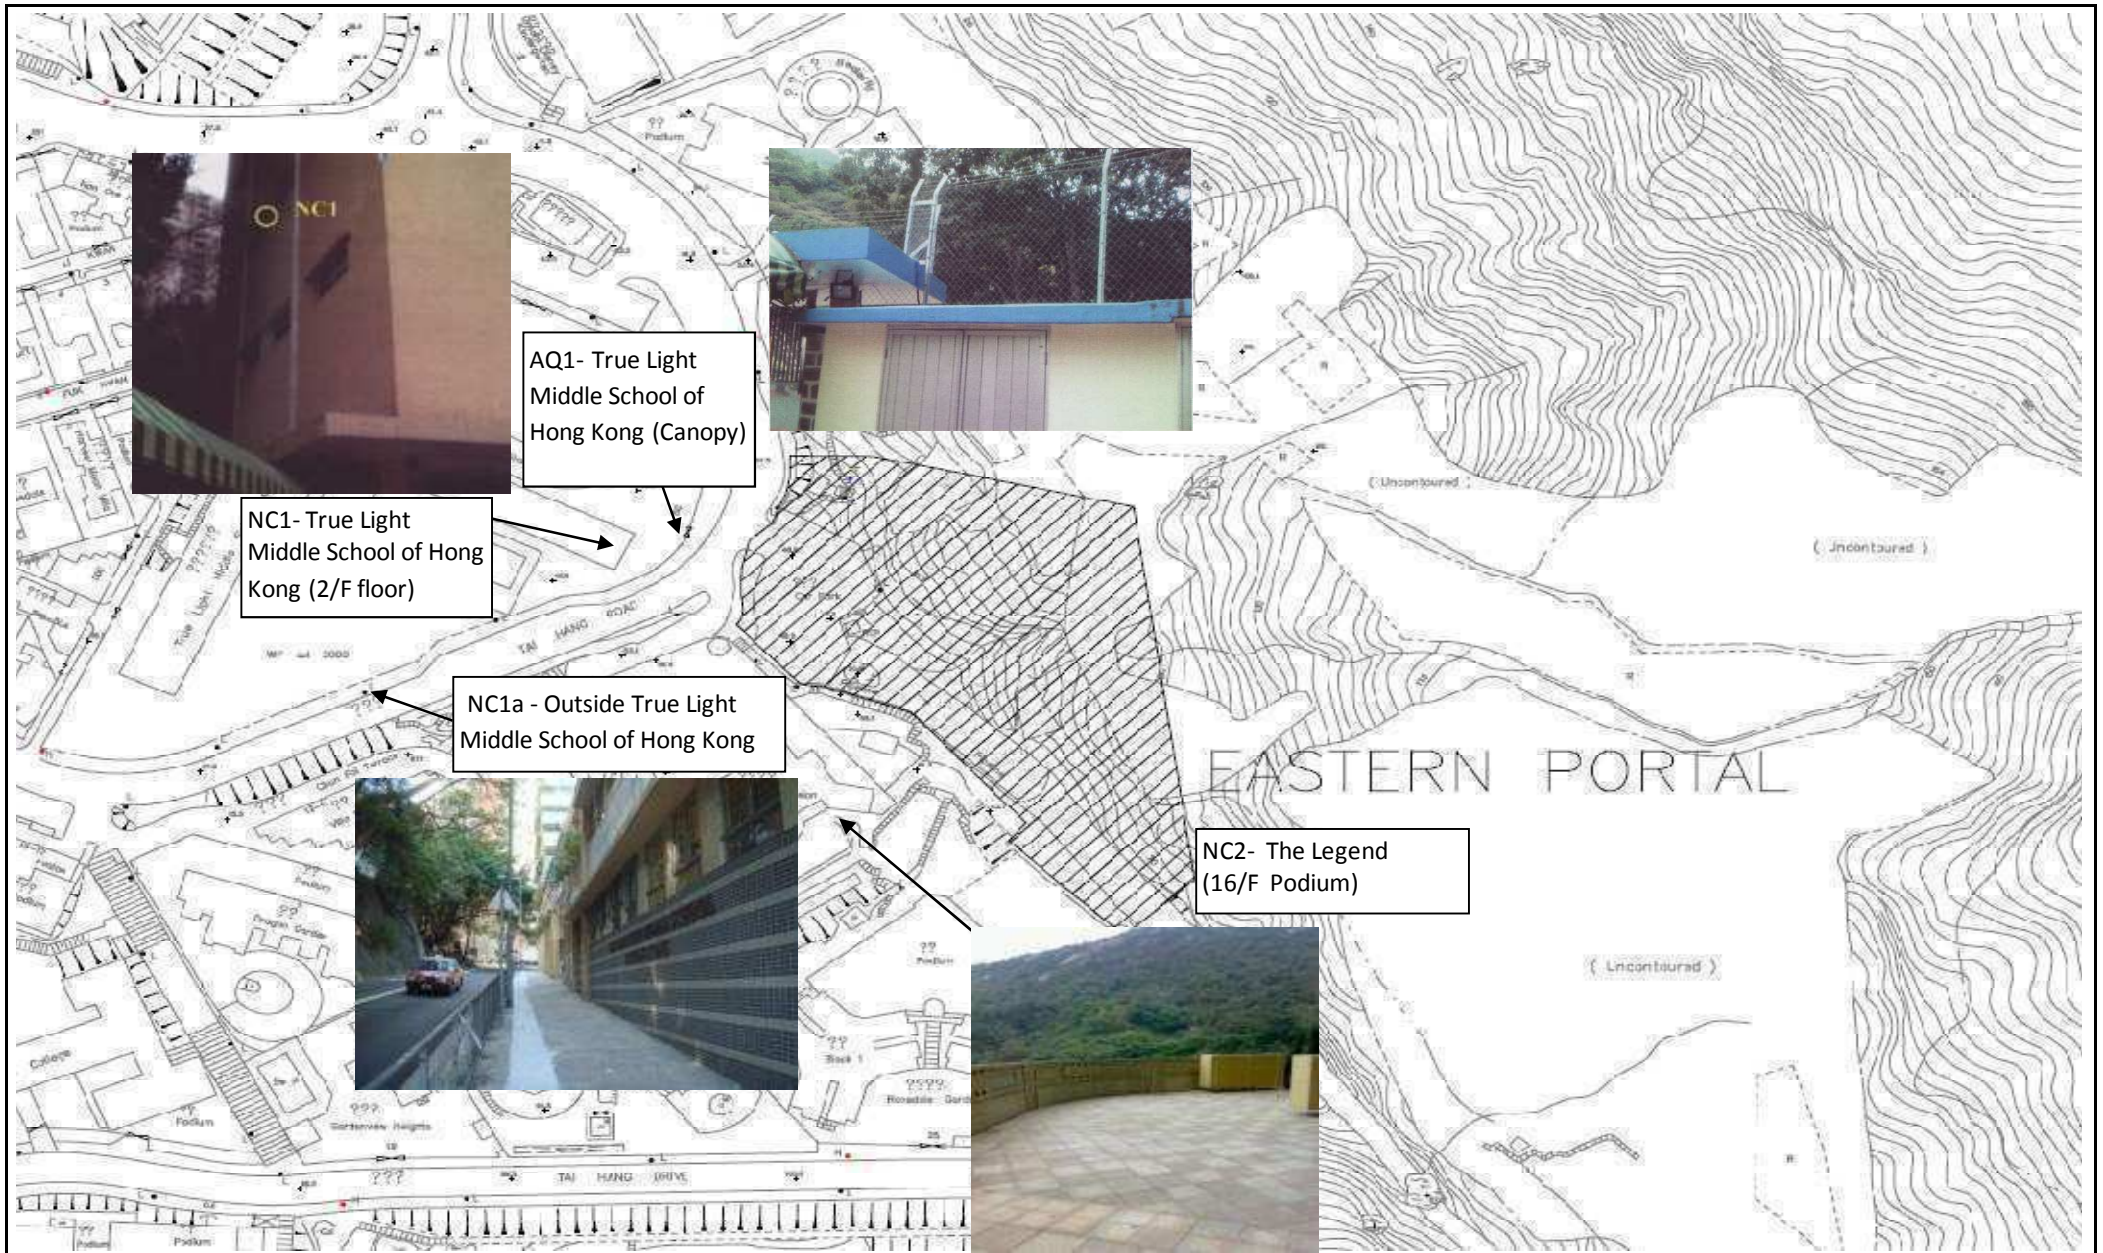


Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Eastern Portal)  
 Locations of Air Quality and Noise Monitoring Station


Scale  
 N.T.S  
 Date  
 Sep-09

Project  
 No. MA 8001  
 Figure  
 3.1a



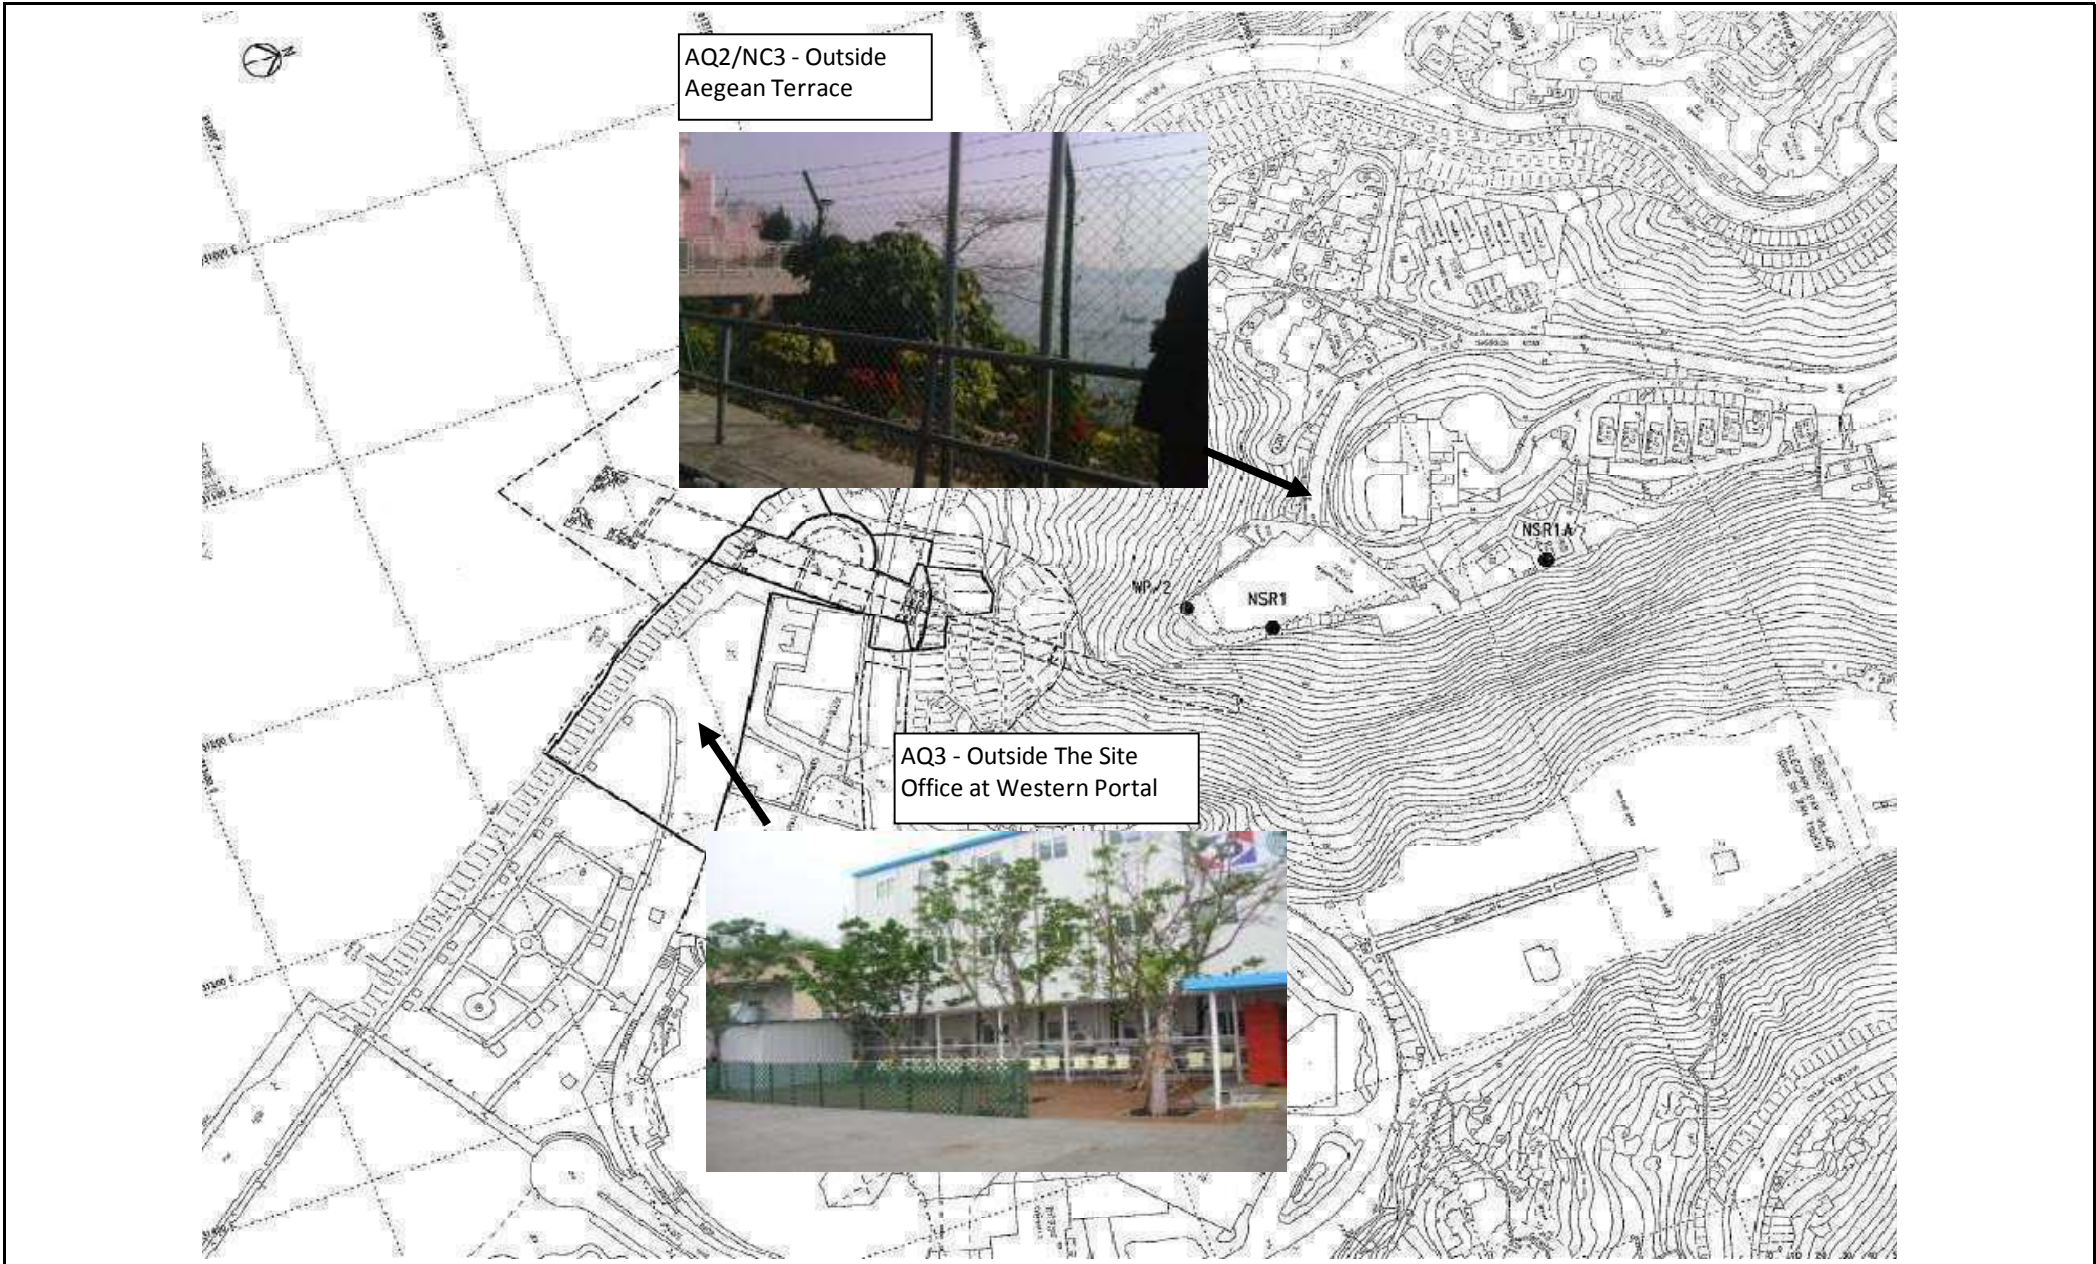

Title	Contract No. DC/2007/10		Scale	Project		CINOTECH
	Design and Construction of Hong Kong West Drainage Tunnel (Western Portal)		N.T.S	No.	MA 8001	
	Locations of Air Quality and Noise Monitoring Station		Date	Sep-09	Figure	3.1b

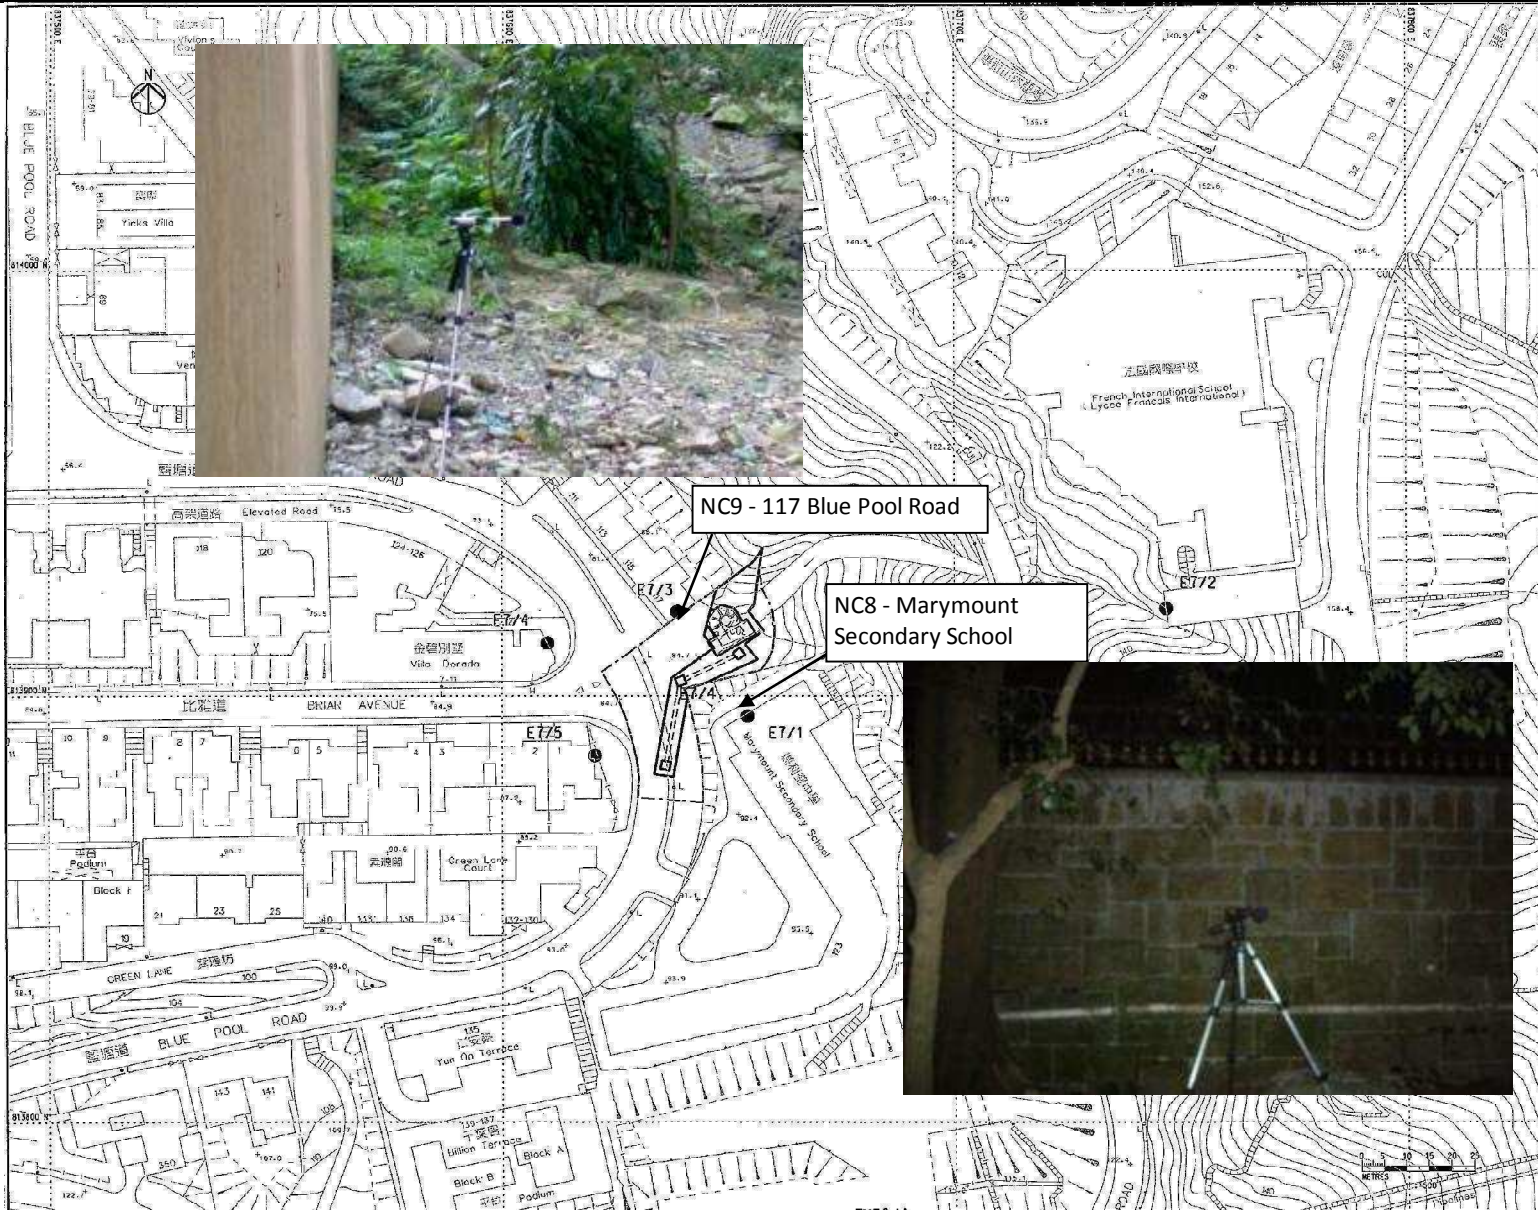

Title	Contract No. DC/2007/10		Scale	Project
	Design and Construction of Hong Kong West Drainage Tunnel (Intake E7)		N.T.S	No. MA 8001
Locations of Noise Monitoring Stations		Date	Figure	
		Sep-09	3.1c	






Title	Contract No. DC/2007/10		Scale	Project
	Design and Construction of Hong Kong West Drainage Tunnel (Intake PFLR1)		N.T.S	No. MA 8001
	Locations of Noise Monitoring Stations		Date	Figure
			Sep-09	3.1d





Title	Contract No. DC/2007/10		Scale	Project
	Design and Construction of Hong Kong West Drainage Tunnel (Intake W0)			
	Locations of Noise Monitoring Stations		Date	Figure
			Oct-11	3.1e




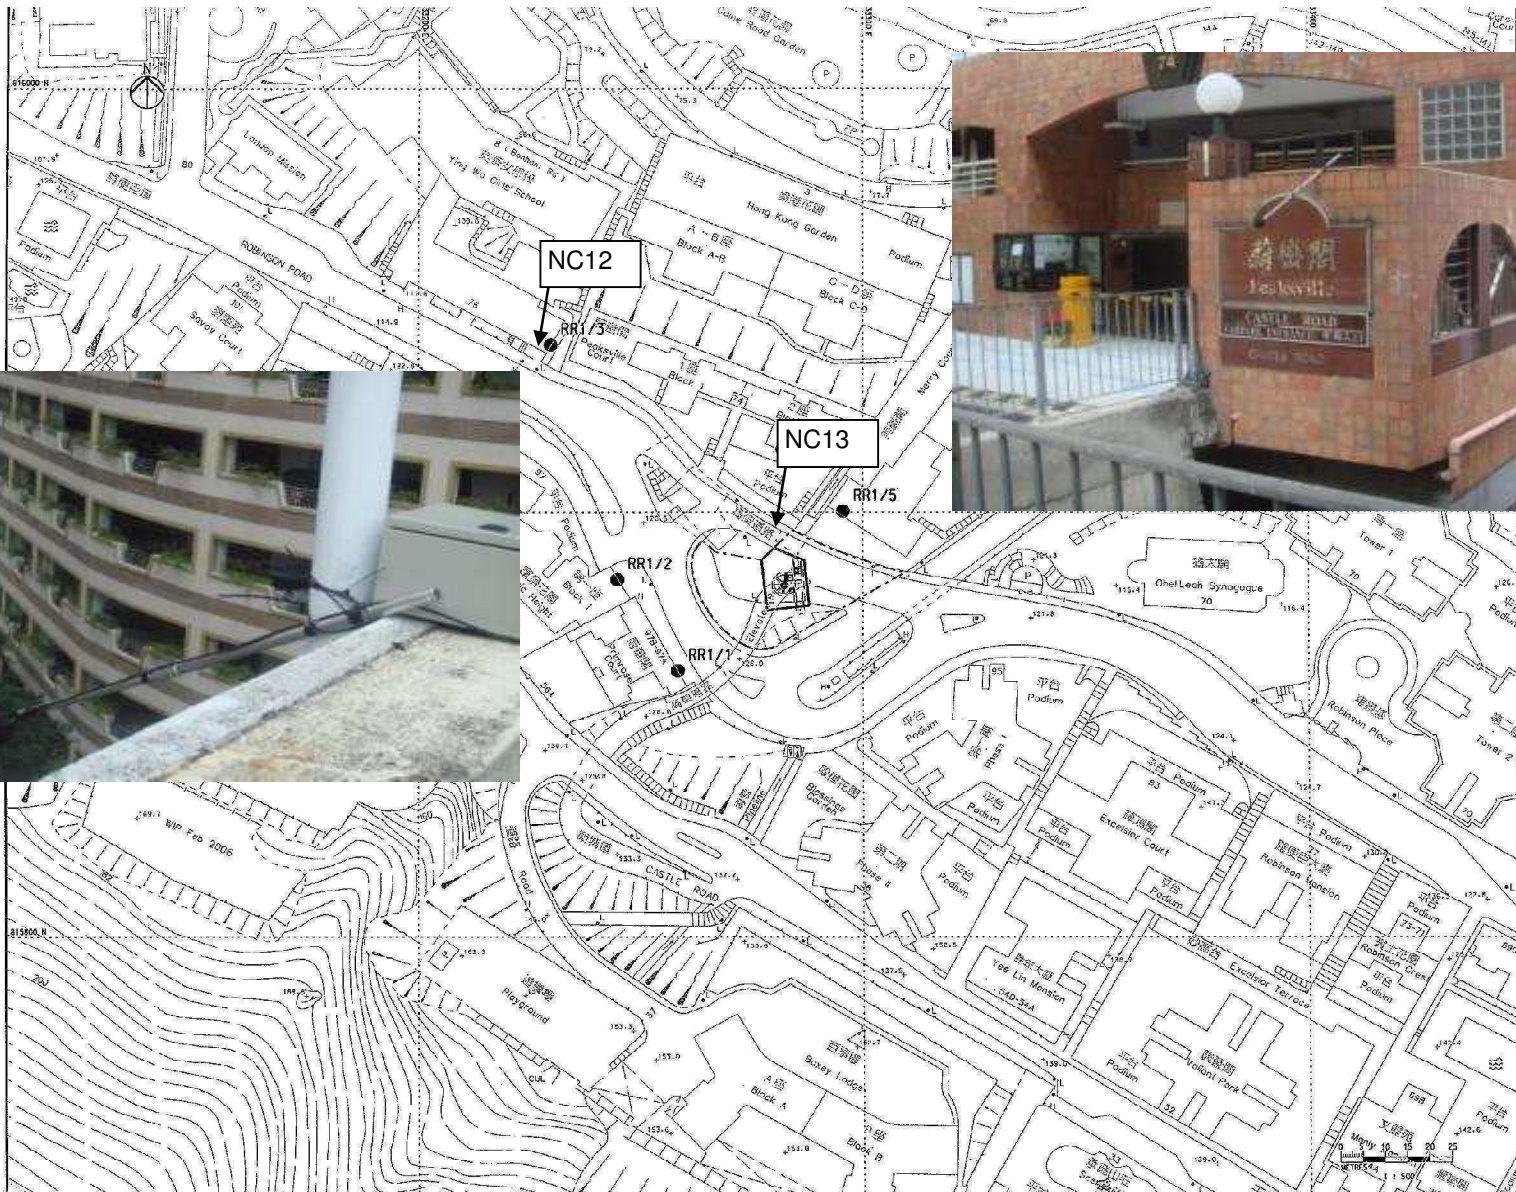

Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intakes RR1)  
 Locations of Noise Monitoring Stations

Scale	N.T.S	Project	
Date	Jan 10	No.	MA 8001
		Figure	3.1f



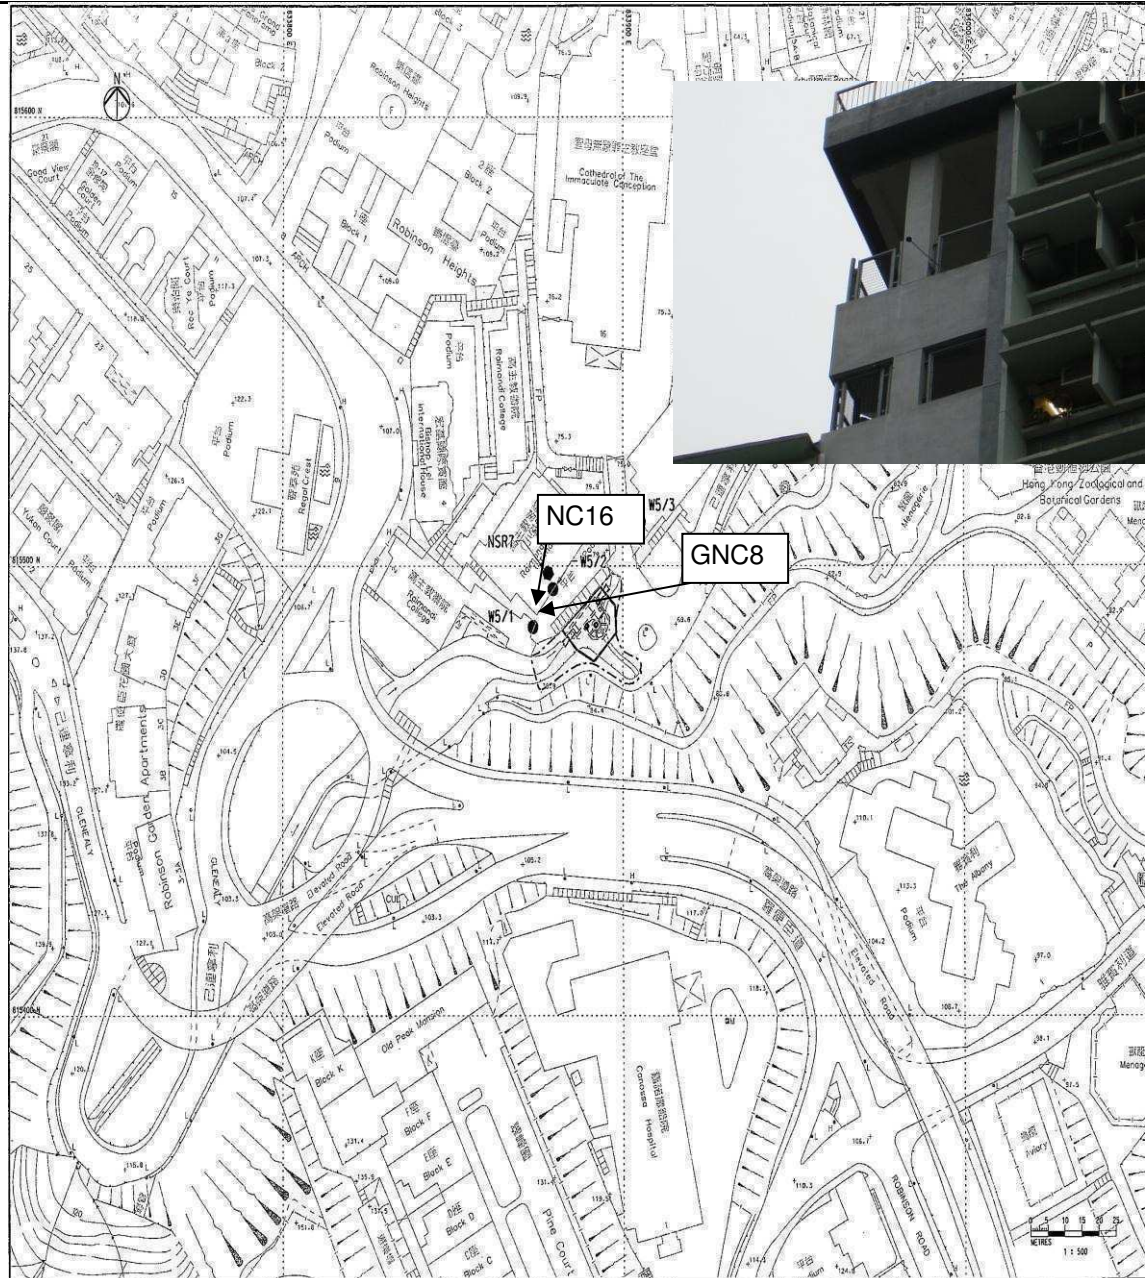

Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intakes W5)  
 Locations of Air Borne and Ground Borne Noise Monitoring Stations

Scale	N.T.S	Project No.	MA 8001
Date	Jan-12	Figure	3.1g





Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intakes E5A)  
 Locations of Noise Monitoring Stations

Scale  
 N.T.S  
 Date  
 Feb-10

Project  
 No. MA 8001  
 Figure  
 3.1h


CINOTECH





Title	Contract No. DC/2007/10		Scale	Project
	Design and Construction of Hong Kong West Drainage Tunnel (Intake THR2)		N.T.S	No. MA 8001
	Locations of Noise Monitoring Stations		Date	Figure
			Feb-10	3.1i




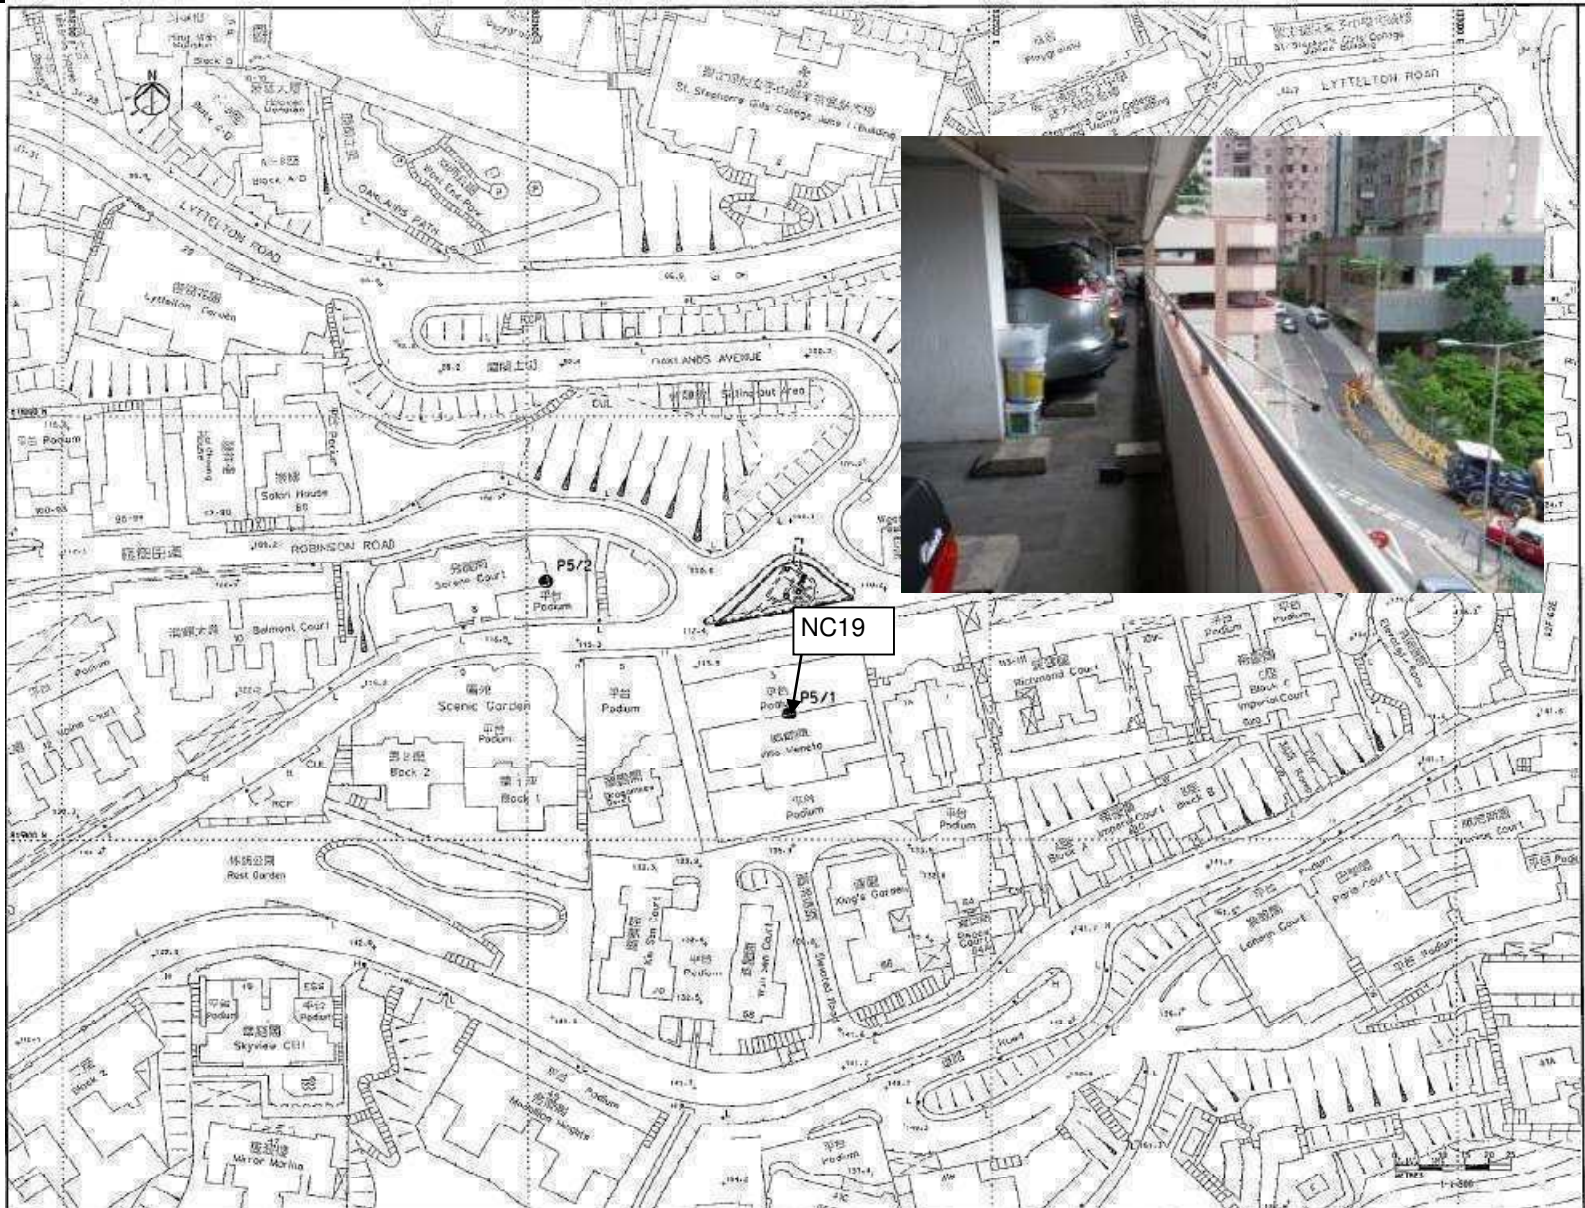

Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intakes P5)  
 Locations of Noise Monitoring Stations

Scale	N.T.S	Project No.	MA8001
Date	Feb-10	Figure	3.1j



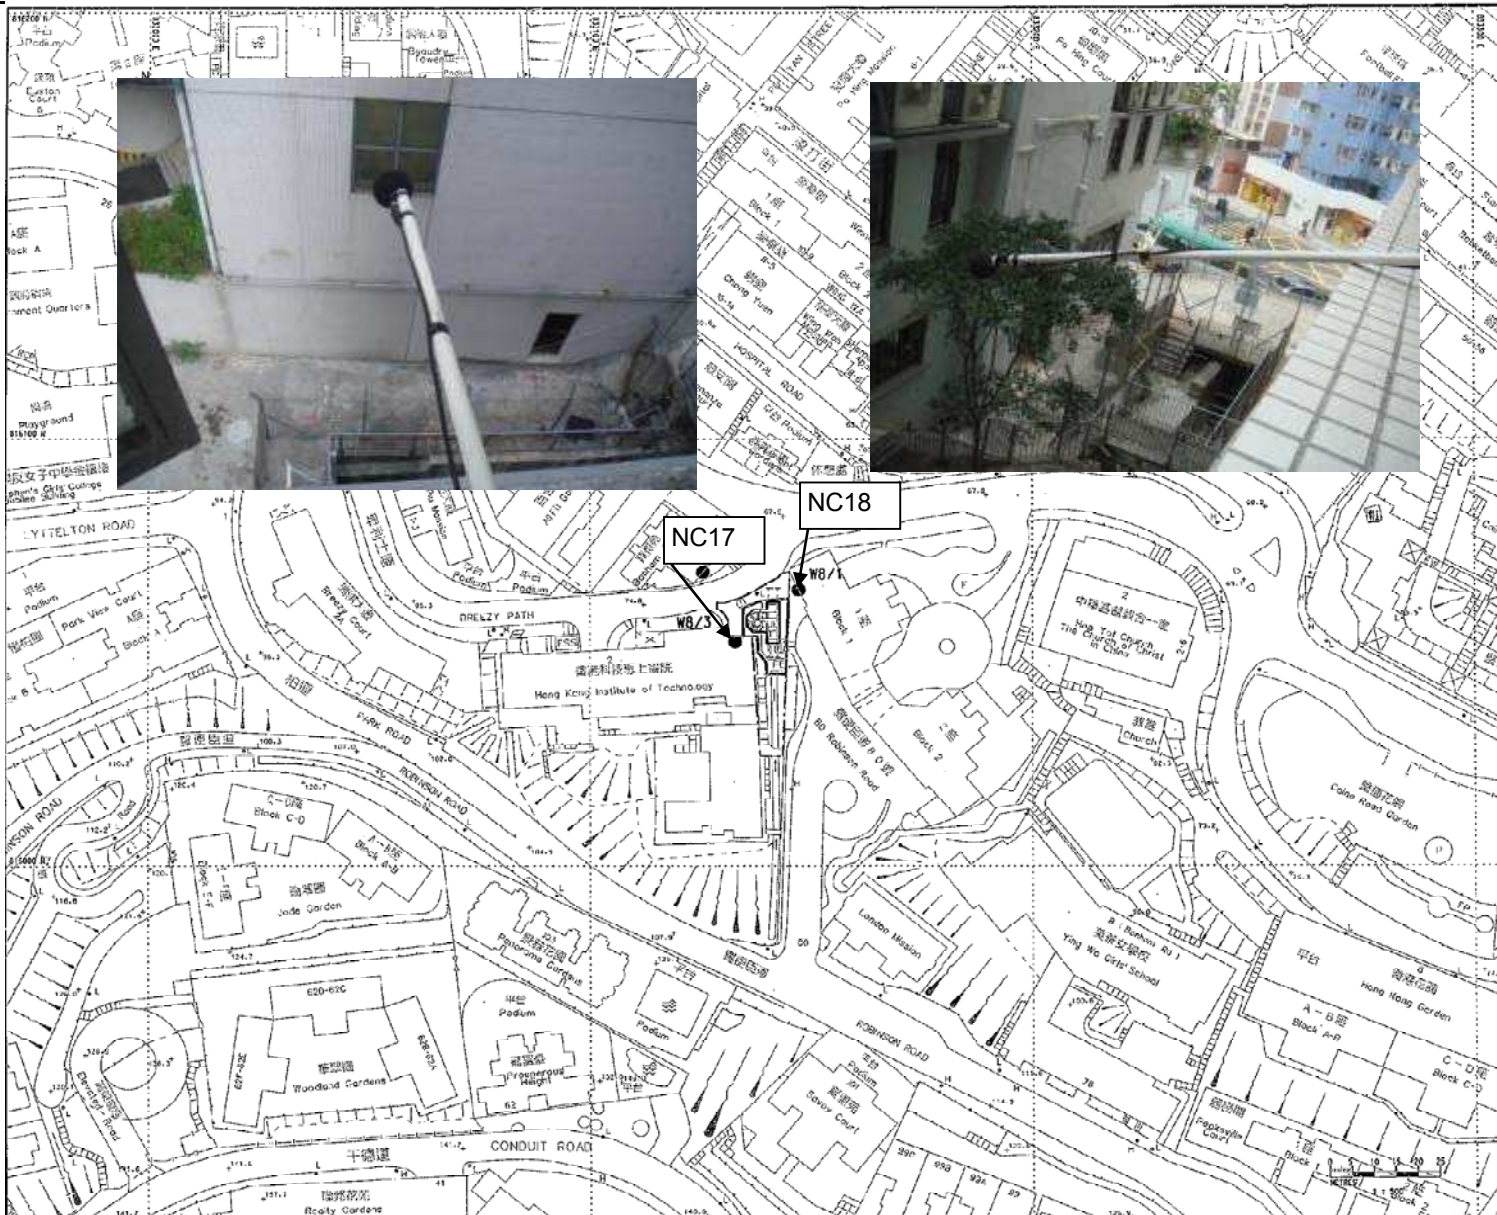

Title

Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intake W8)  
 Locations of Noise Monitoring Stations

Scale

N.T.S

Project

No. MA8001


Date

Jun-10

Figure

3.1k


CINOTECH

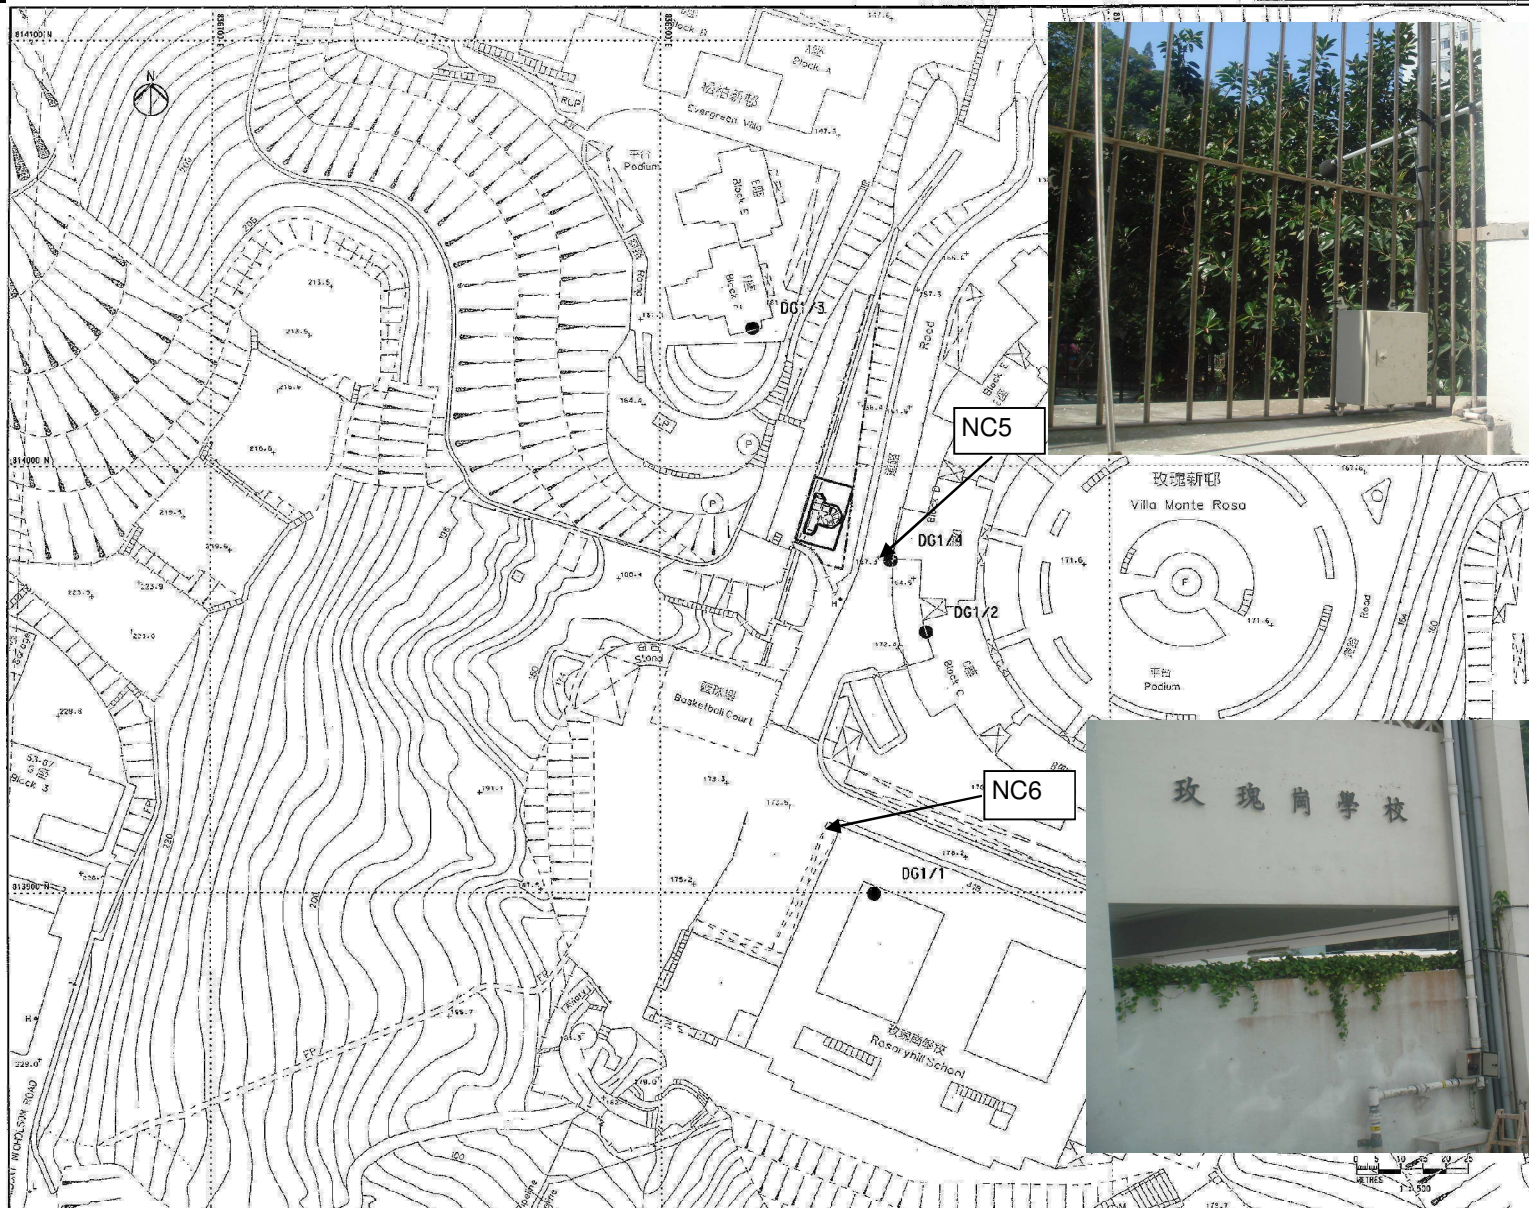

Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intake DG1)  
 Locations of Noise Monitoring Stations


Scale	N.T.S	Project No.	MA8001
Date	Aug-10	Figure	3.11



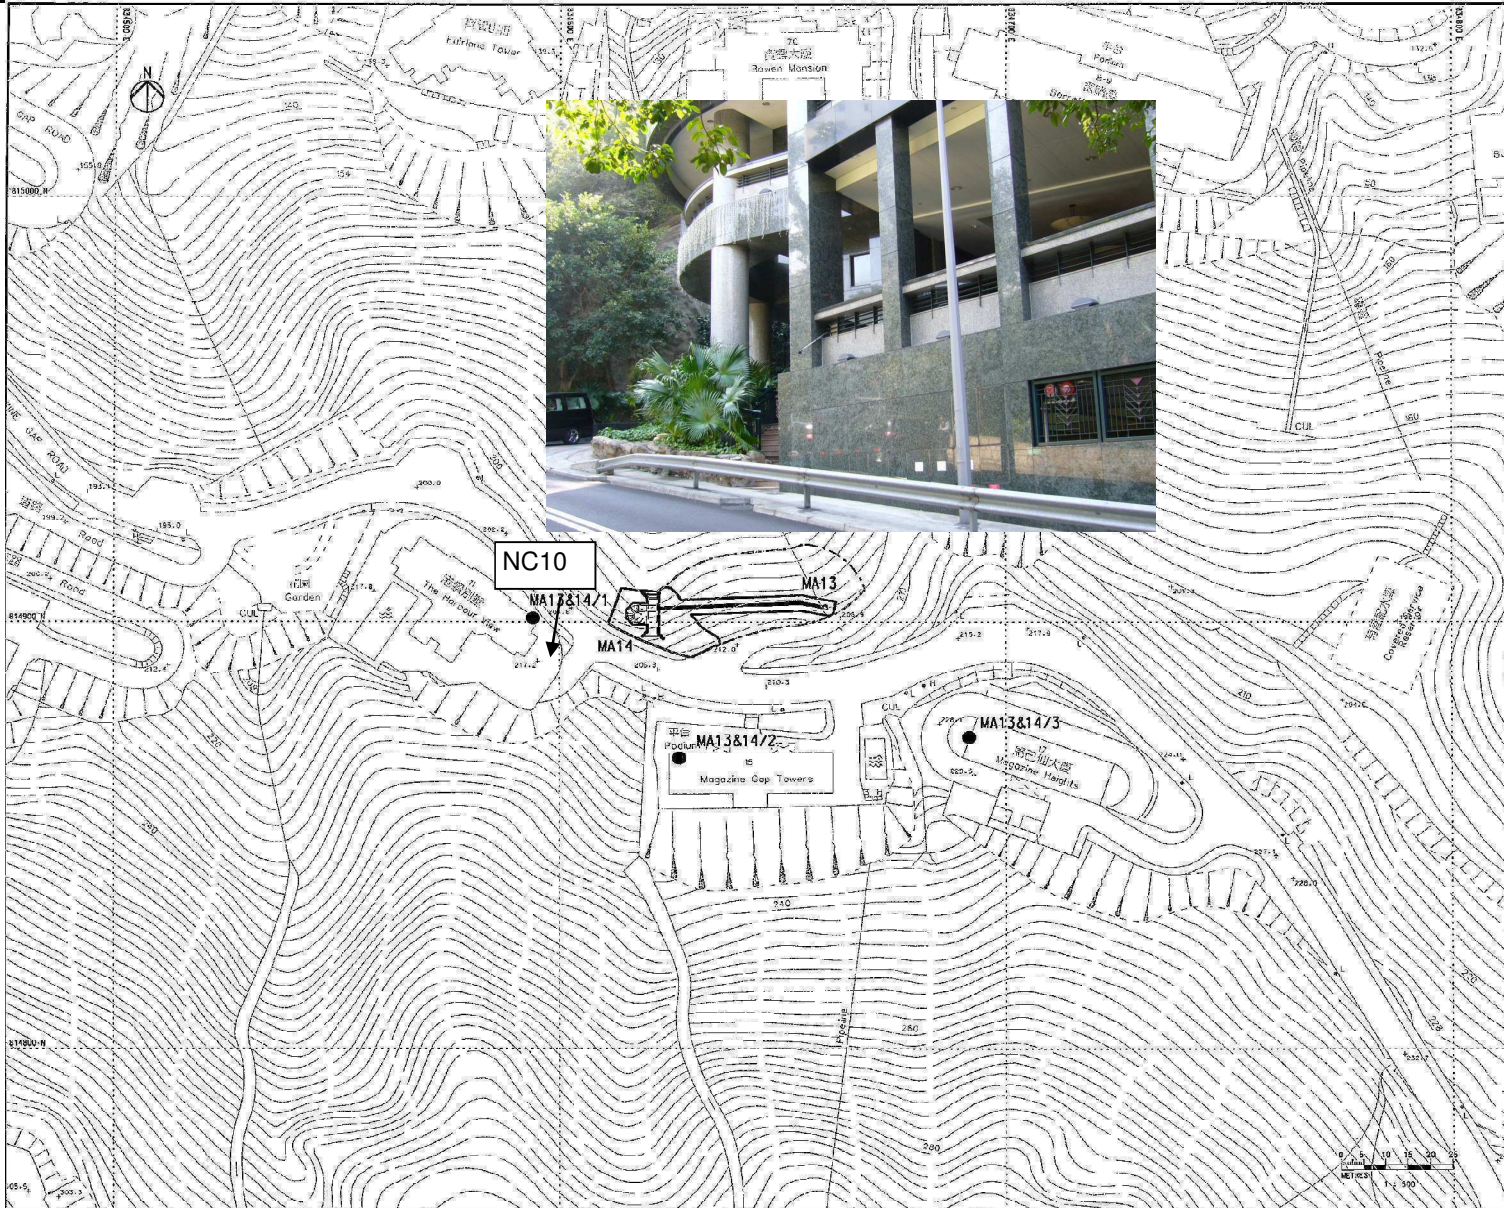

Title	Contract No. DC/2007/10		Scale	Project
	Design and Construction of Hong Kong West Drainage Tunnel (Intake MA14)			
	Locations of Noise Monitoring Stations		Date	Figure
			Aug-10	3.1m




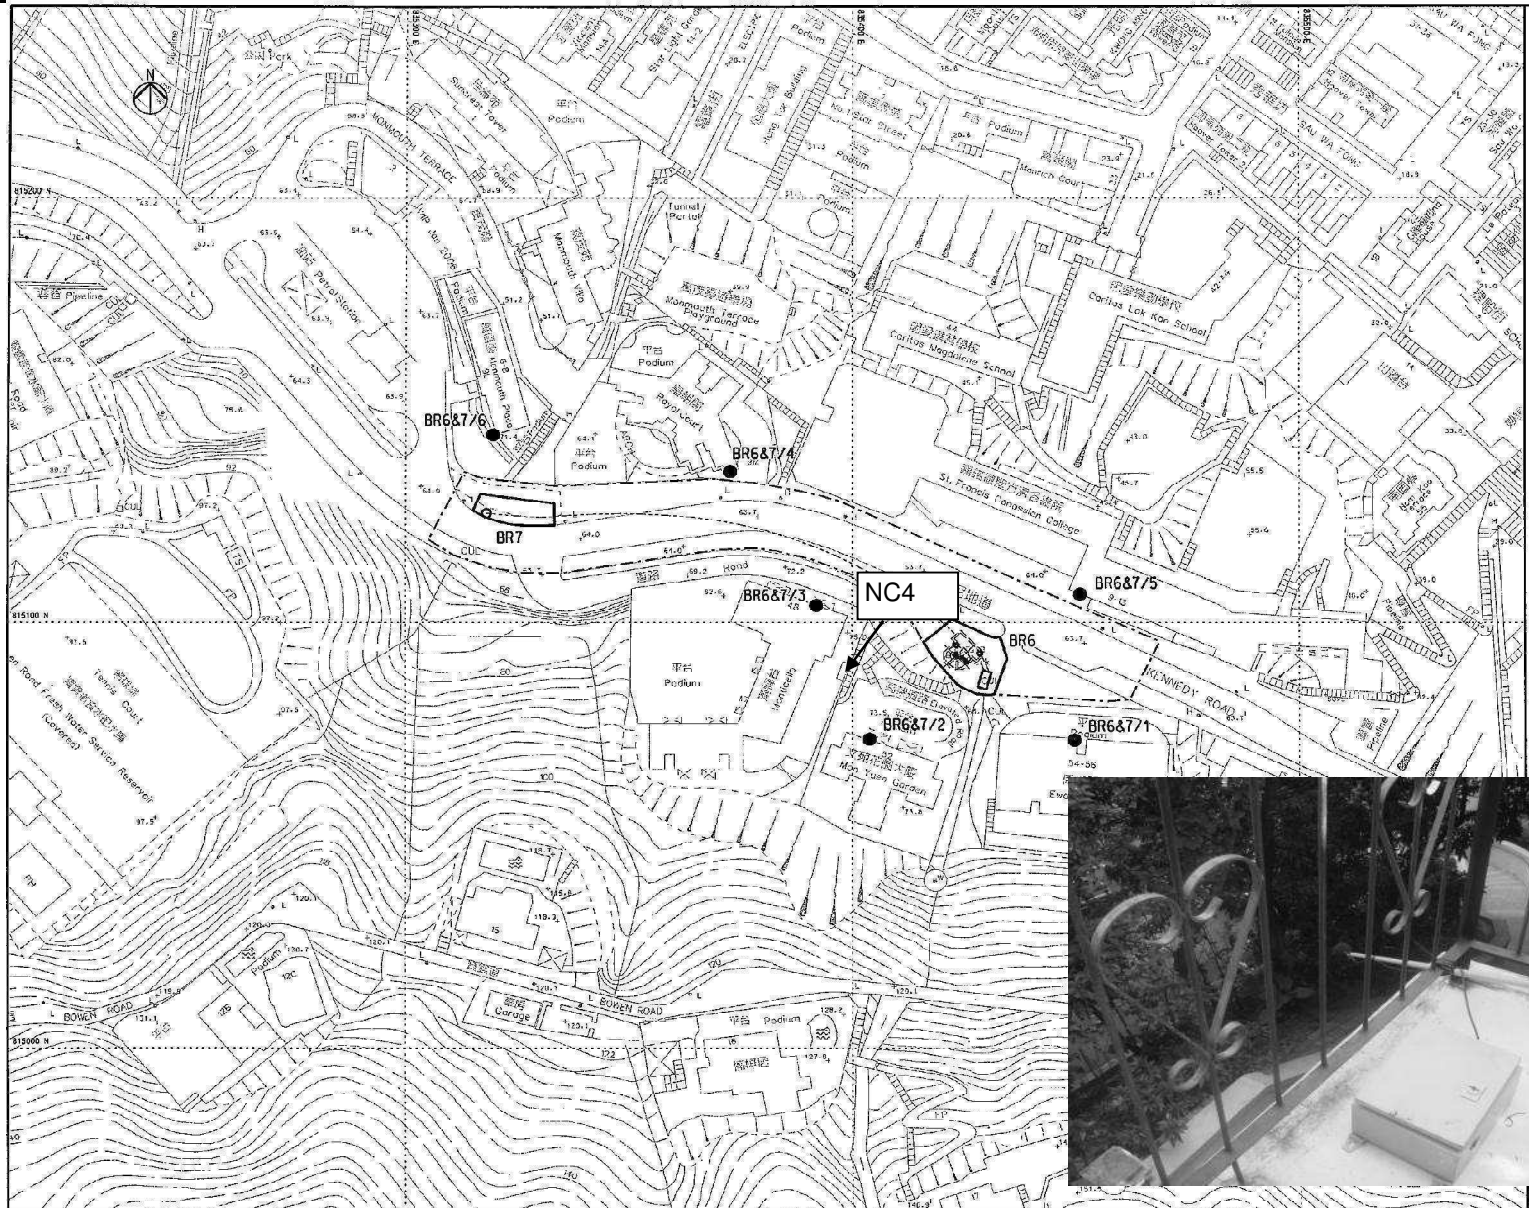


Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intakes BR6)  
 Locations of Noise Monitoring Stations

Scale	N.T.S	Project No.	MA8001
Date	Sep-10	Figure	3.1n



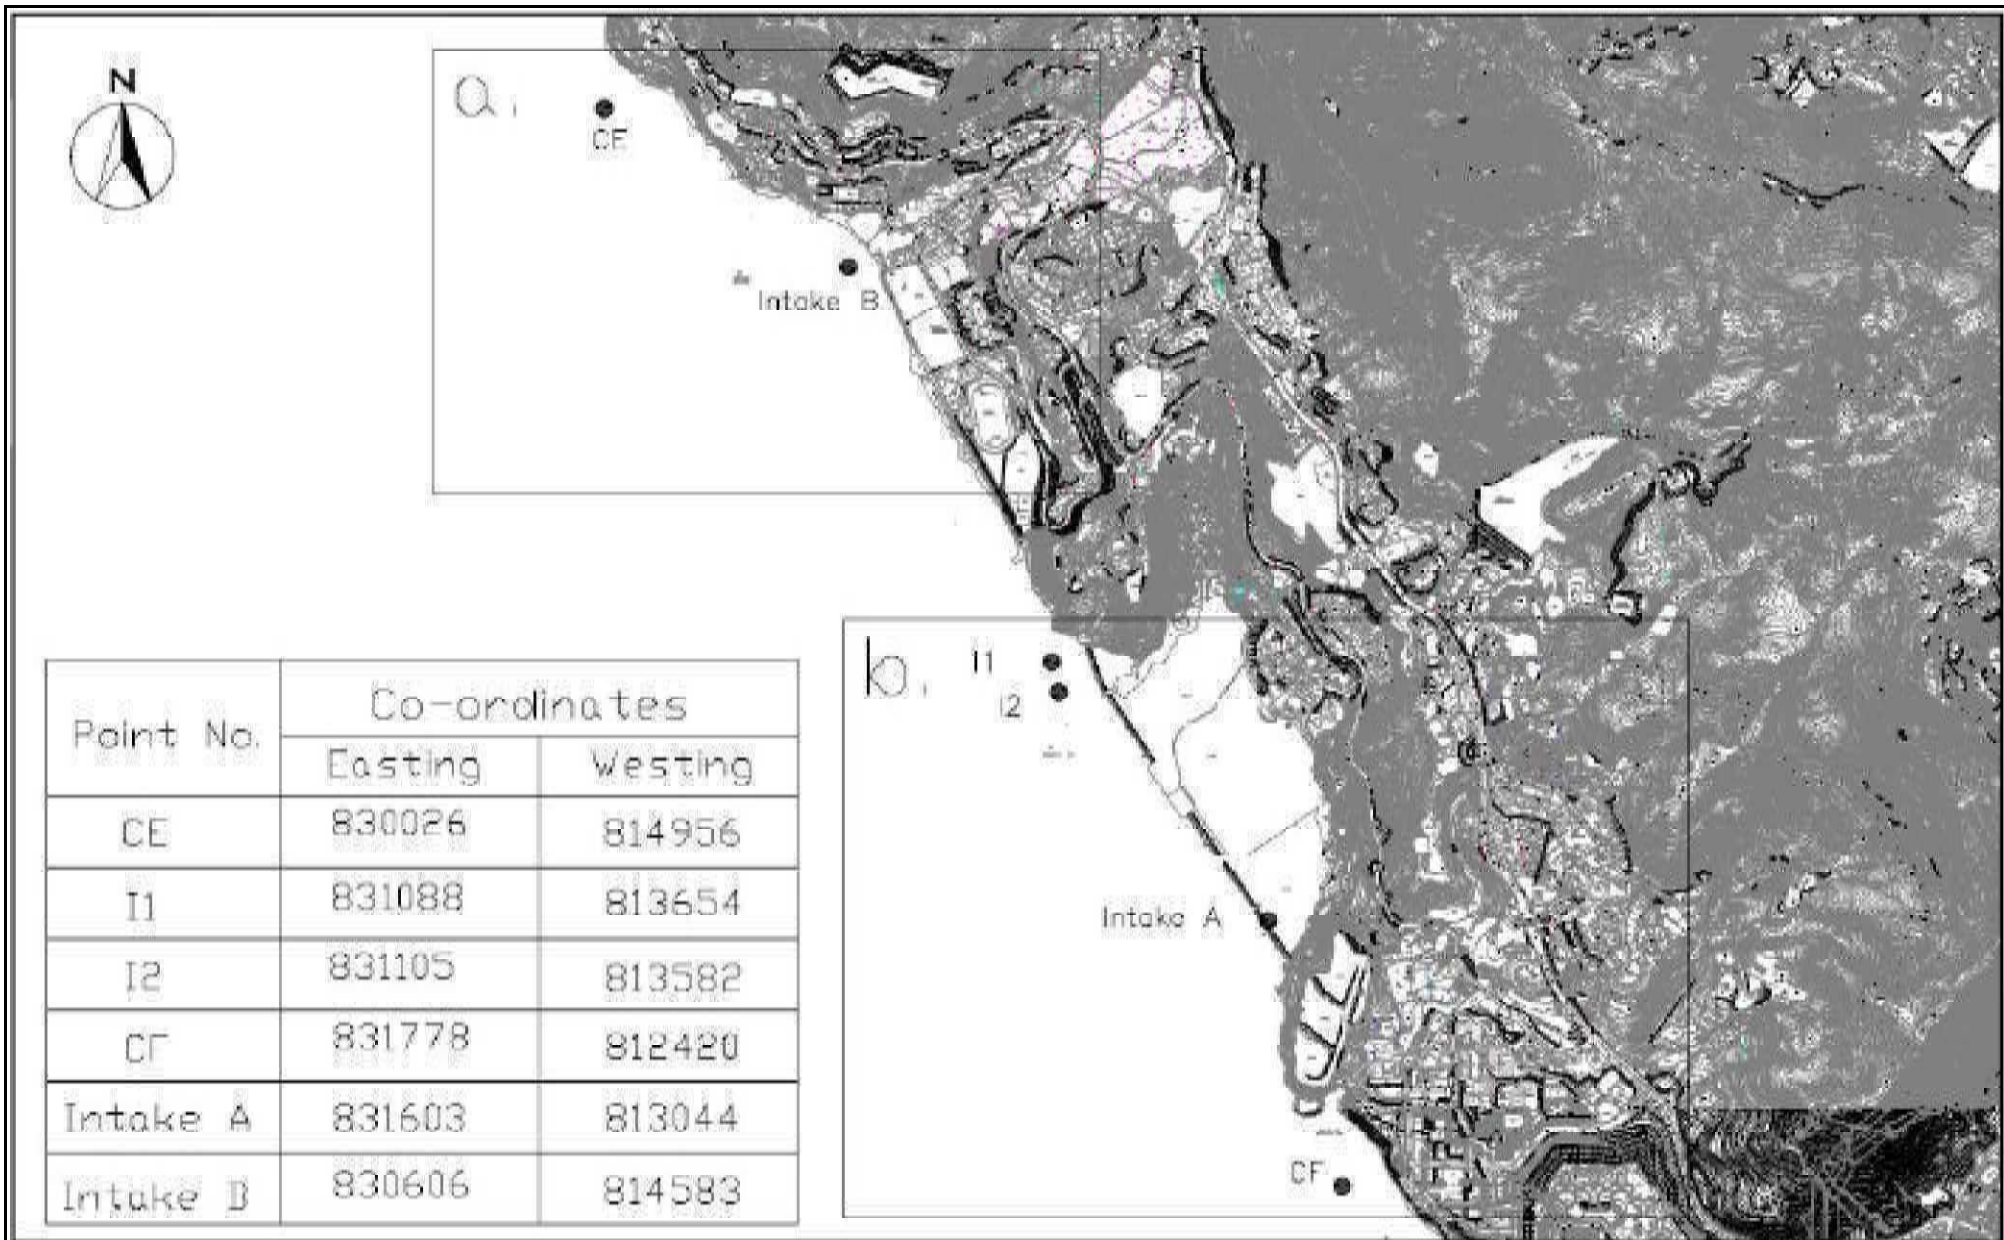

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Locations of Water Quality Monitoring Stations	Scale	Project	
		N.T.S	
	Date	Figure	
	Jun-08	4.1	

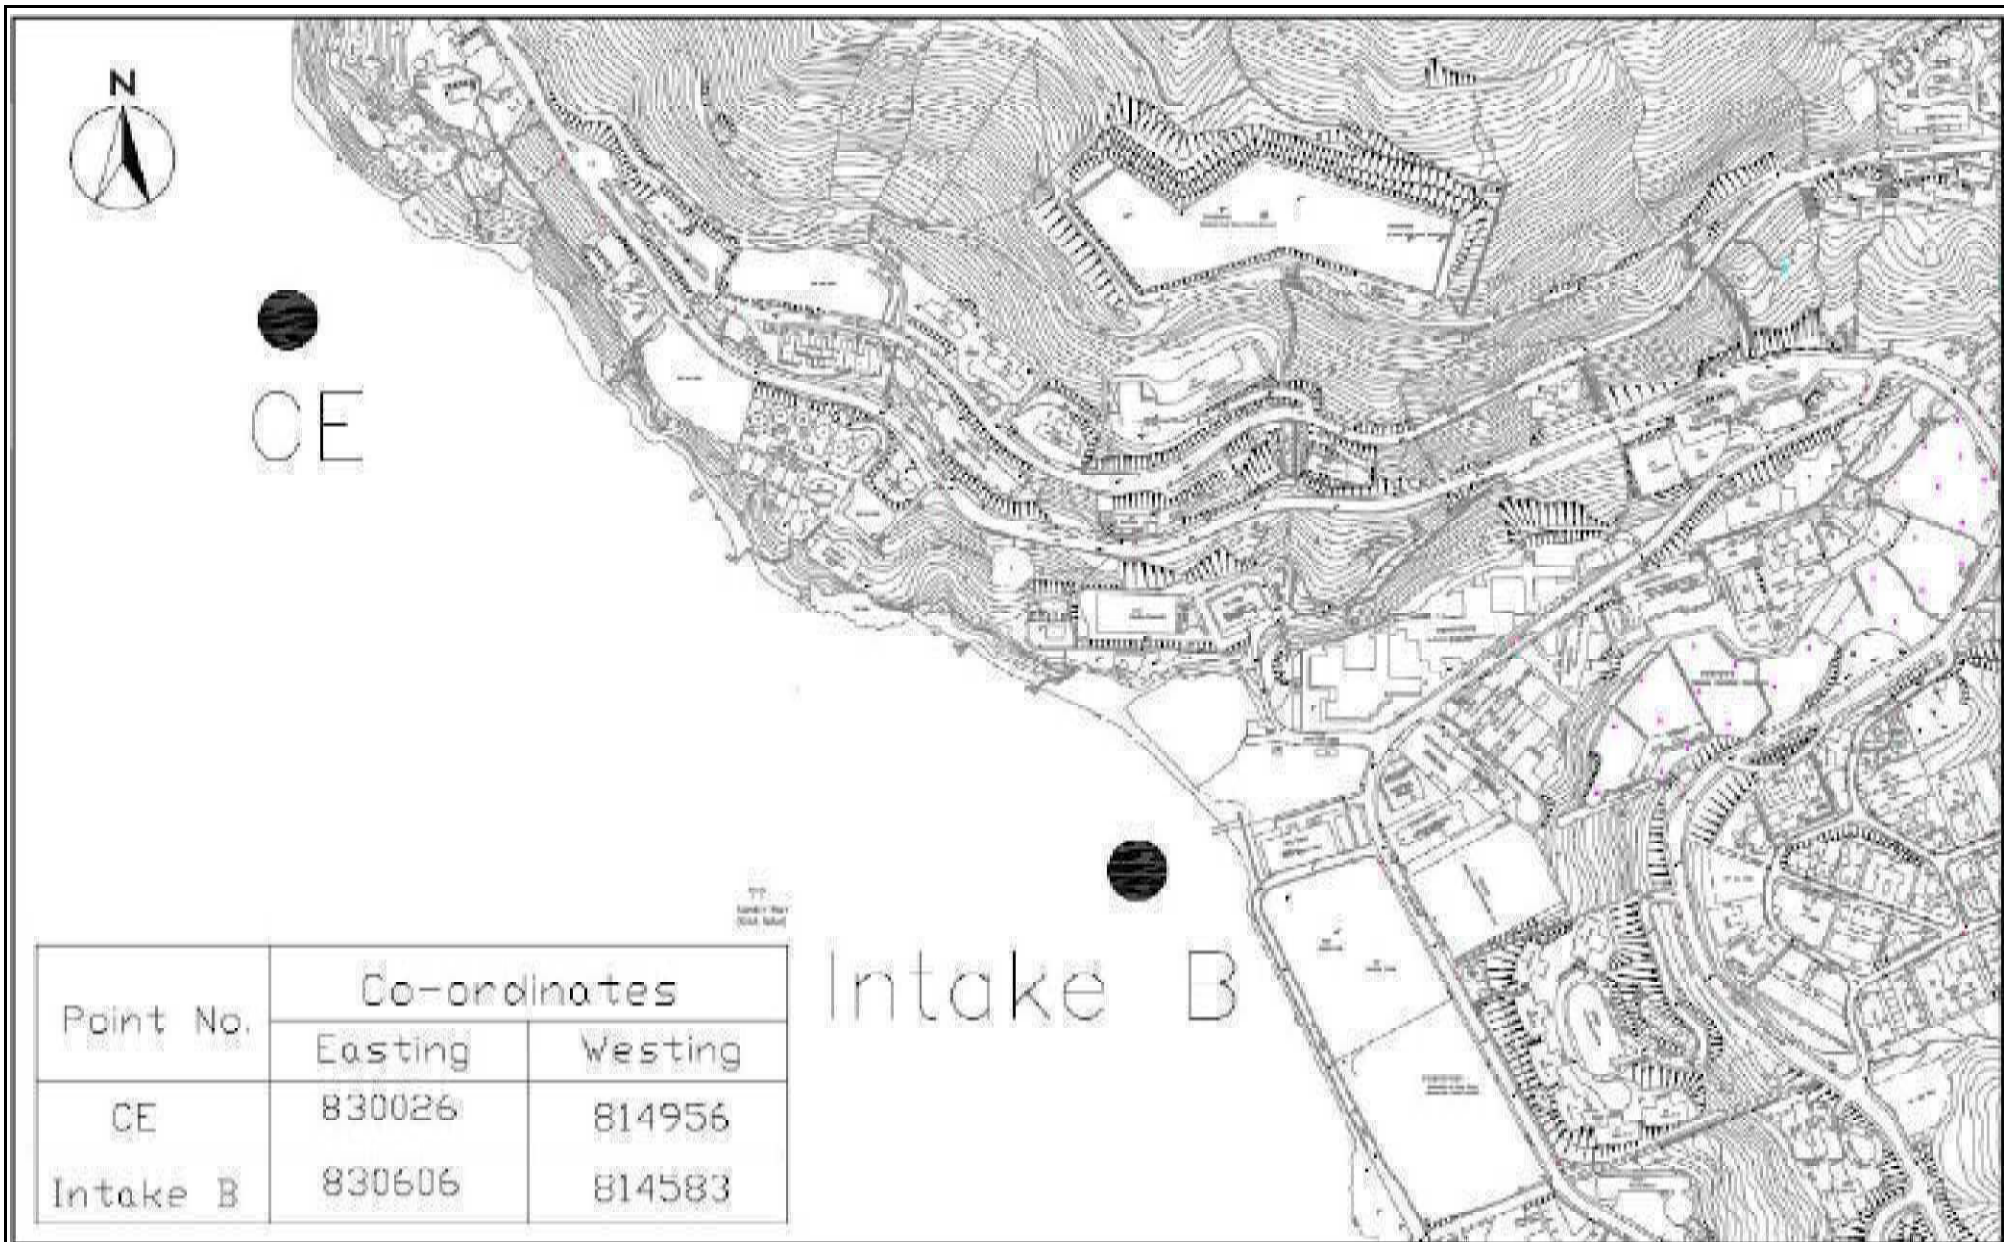


Title Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 Locations of Water Quality Monitoring Stations


Scale	N.T.S	Project No.	MA8001
Date	Jun-08	Figure	4.1a






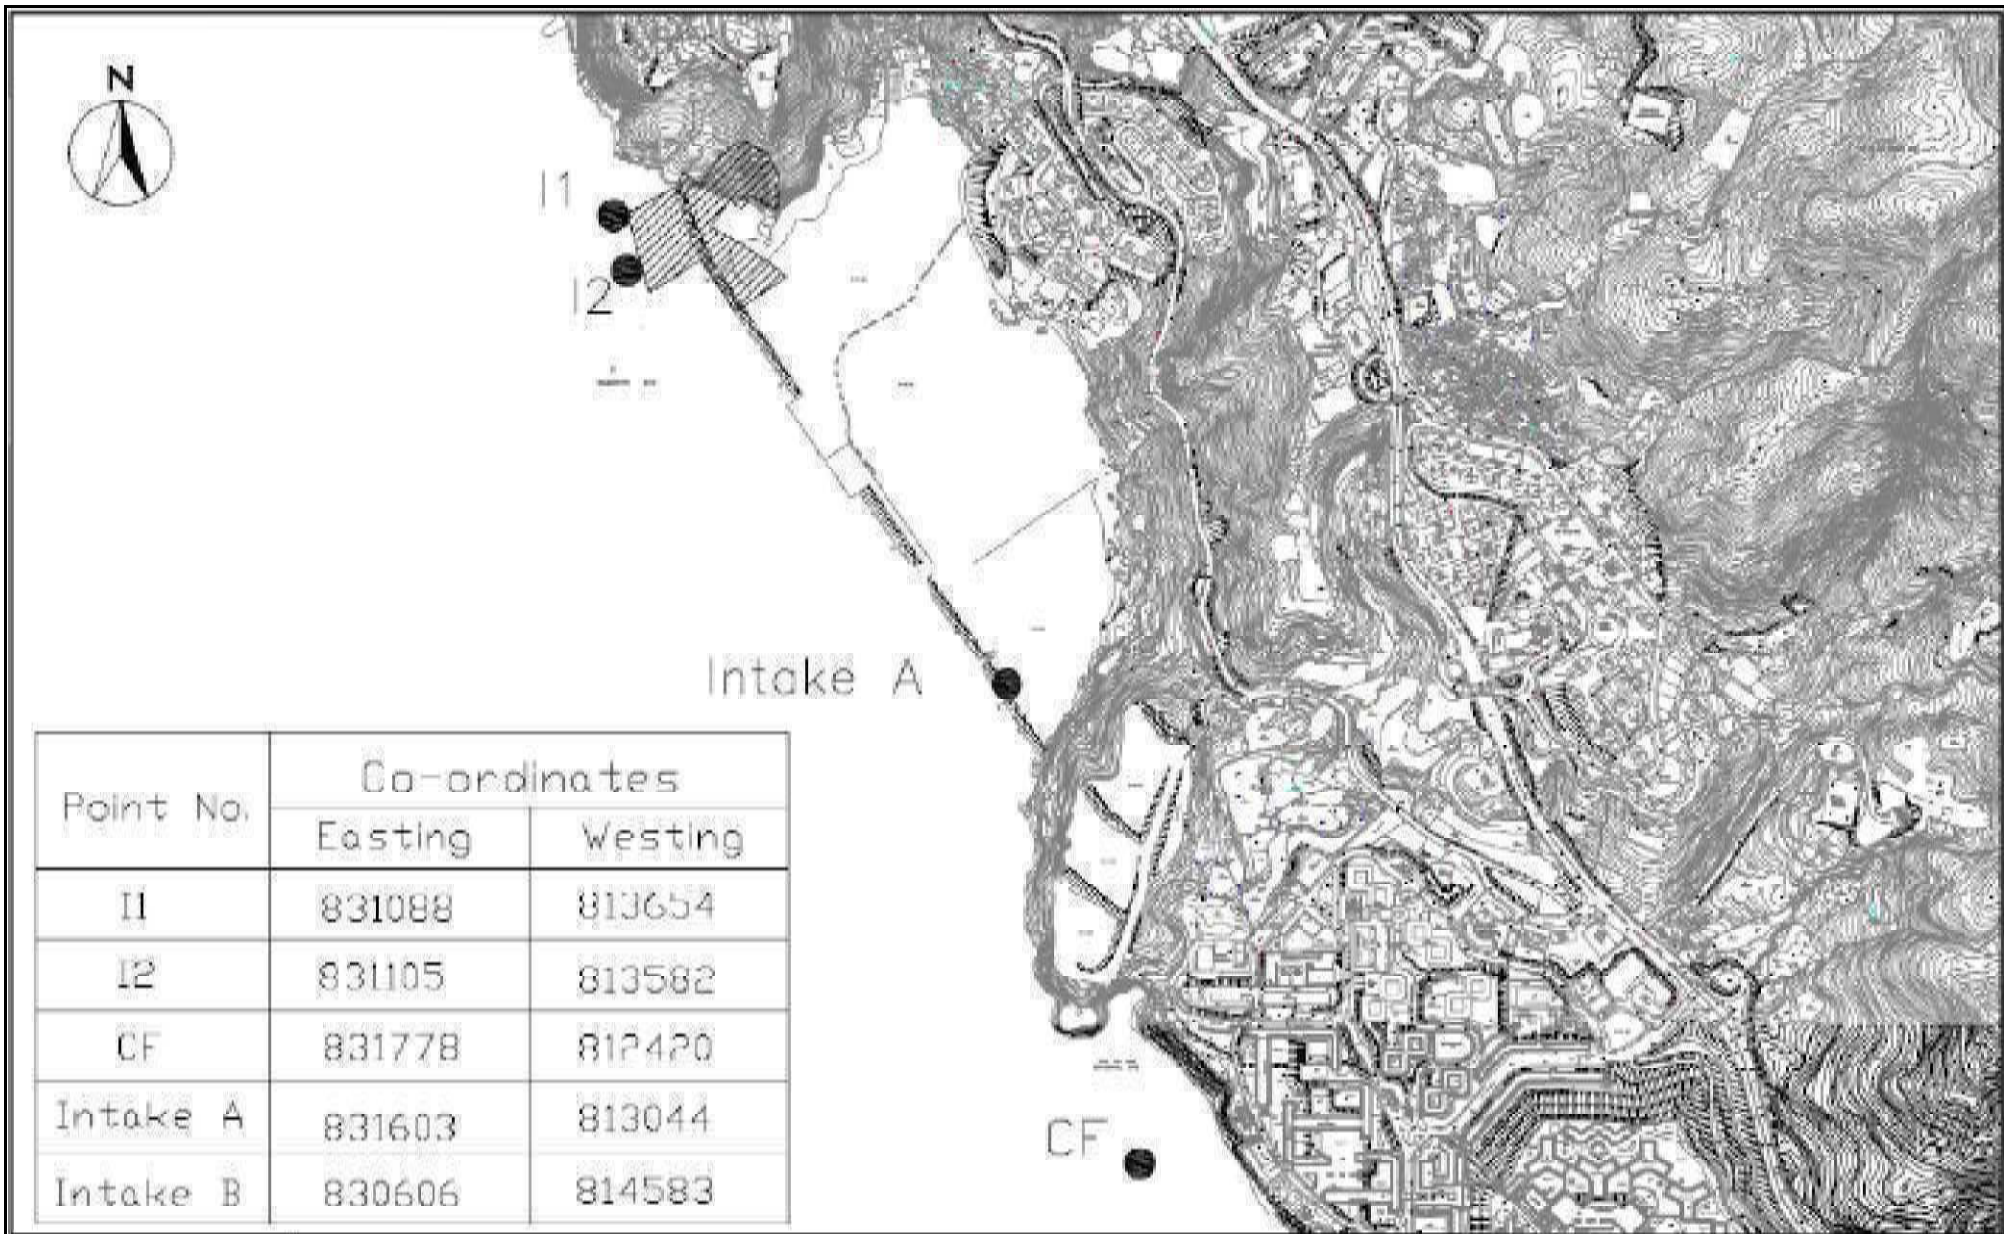

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Locations of Water Quality Monitoring Stations	Scale	Project	
	Date	Figure	
	N.T.S	No. MA8001	
	Jun-08	4.1b	

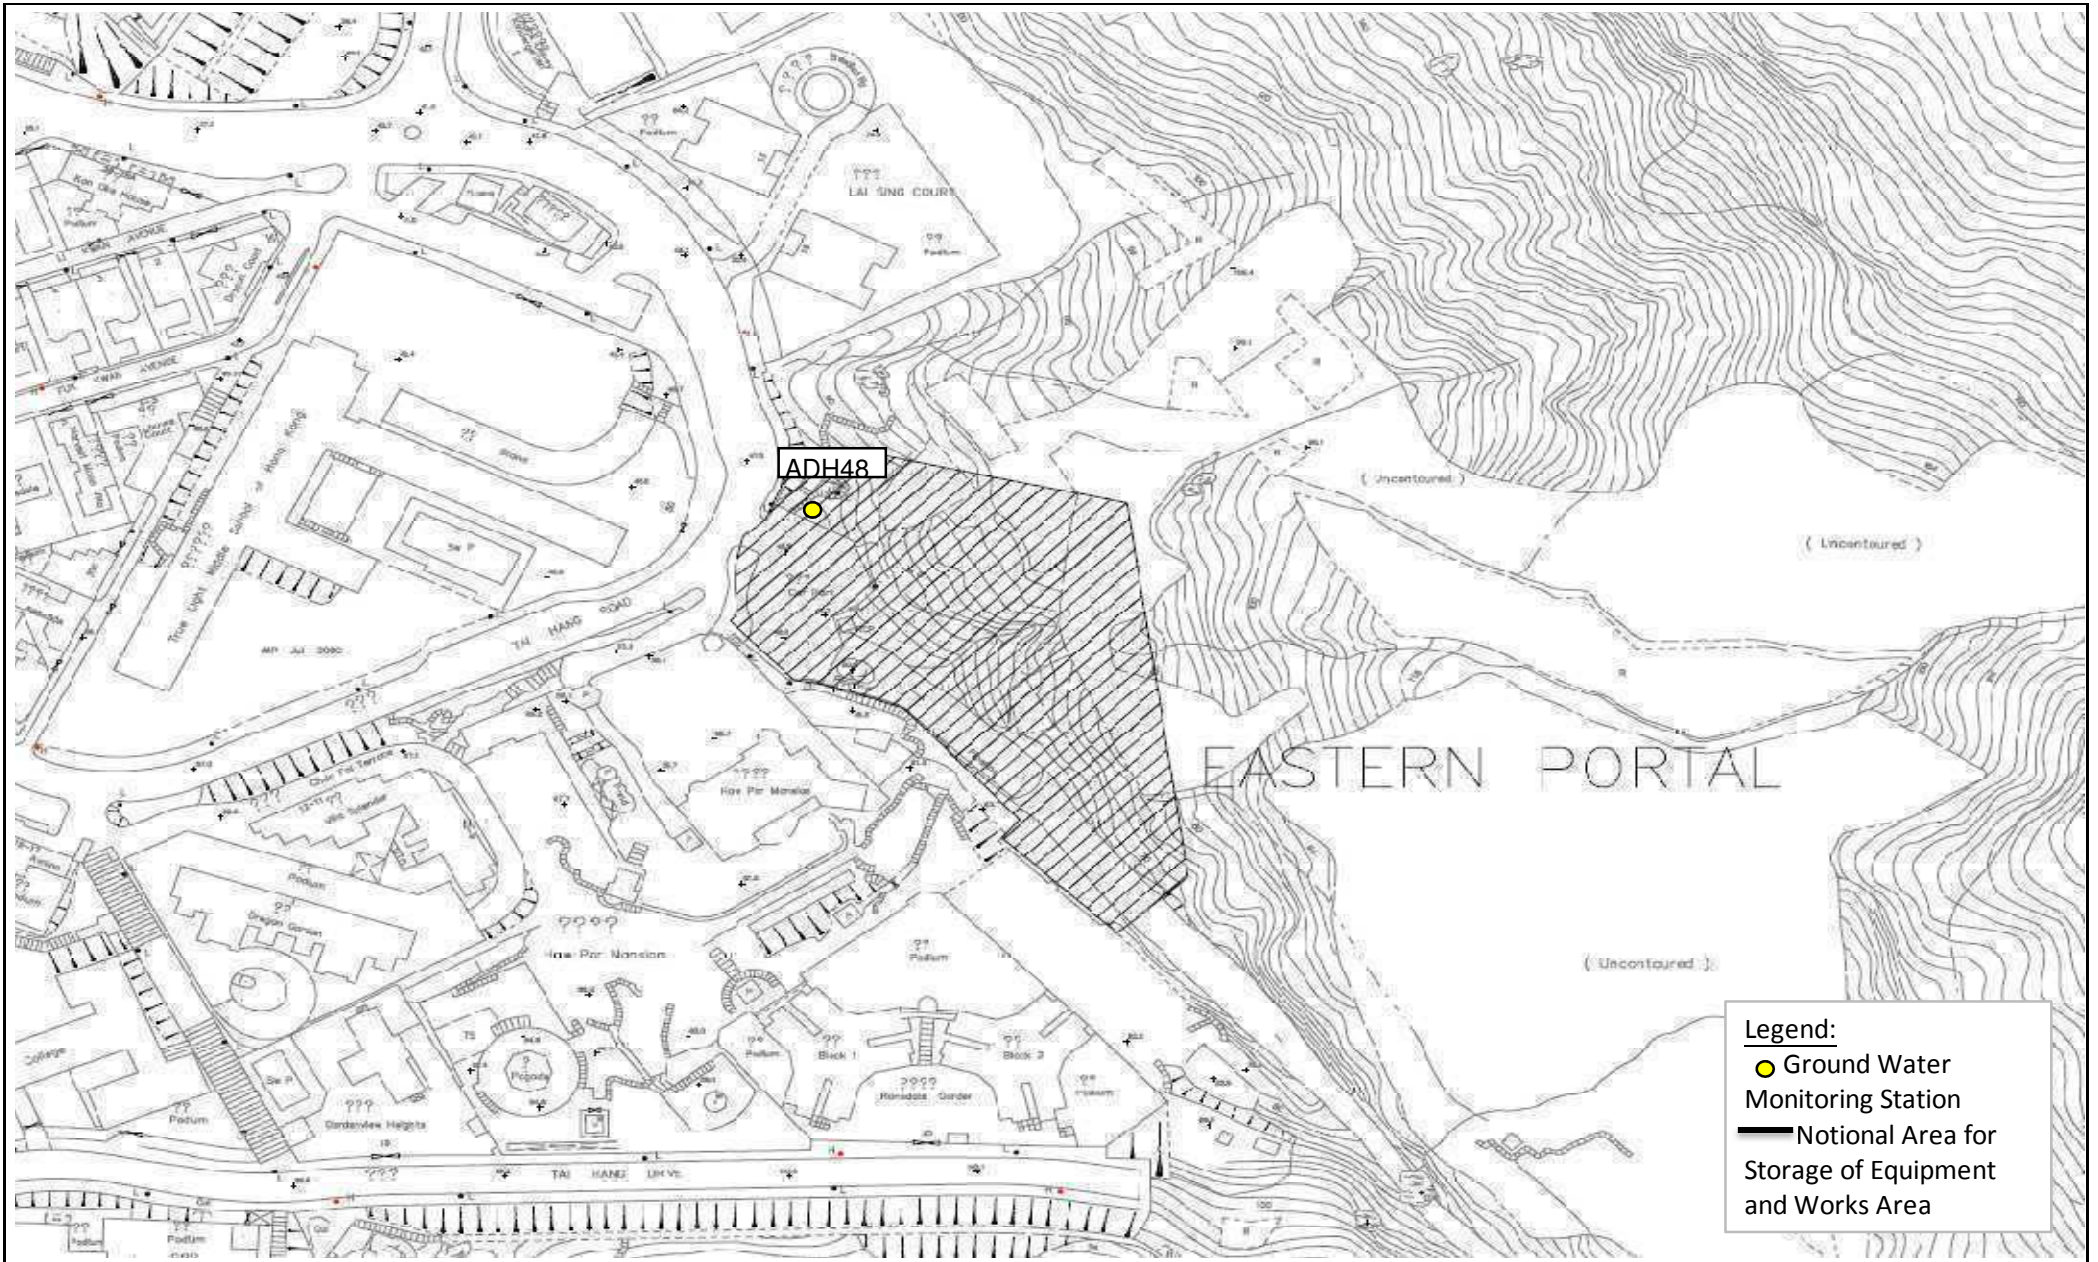

Title	Contract No. DC/2007/10		Scale	Project	CINOTECH
	Design and Construction of Hong Kong West Drainage Tunnel (Eastern Portal)		N.T.S	No. MA8001	
	Location of ground water level Monitoring Station		Date	Figure	
			Mar-10	4.2a	

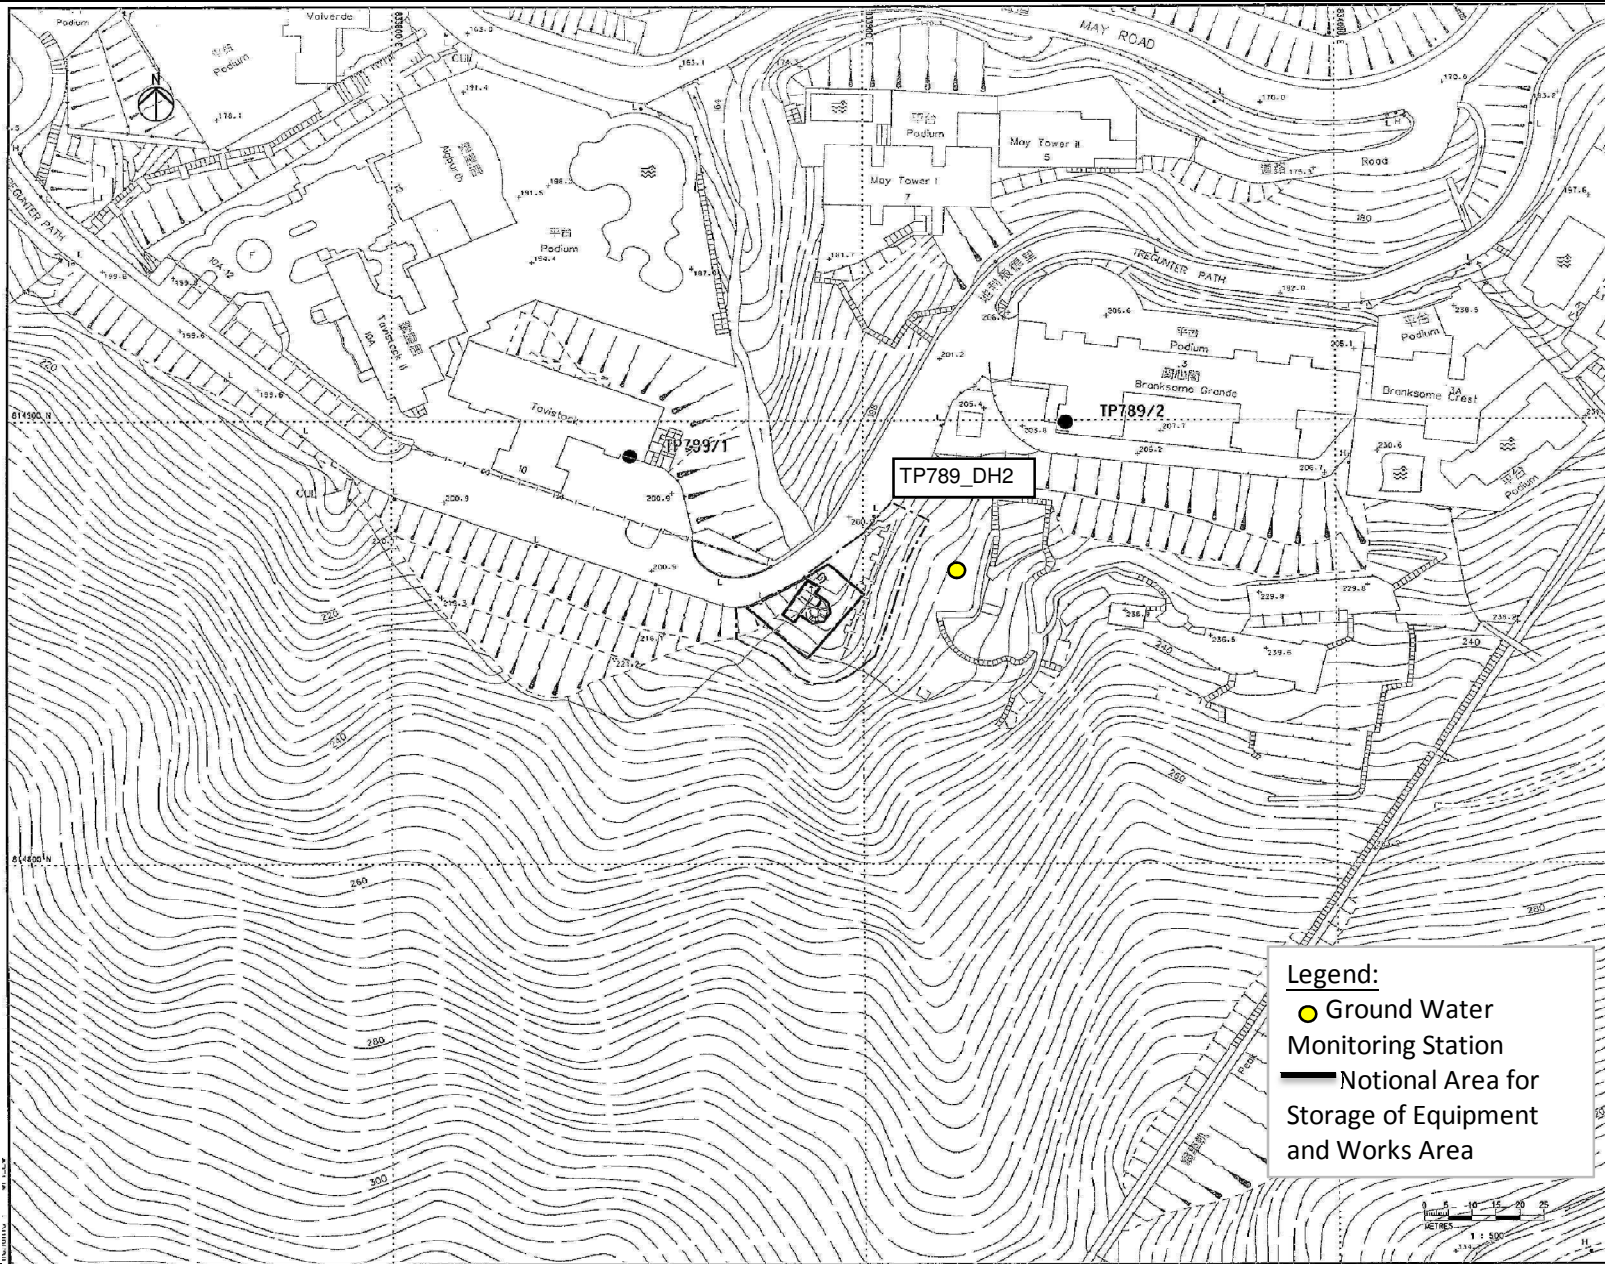

Title

Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intake TP789)  
 Location of ground water level Monitoring Station

Scale	N.T.S	Project No.	MA8001
Date	Mar-10	Figure	4.2b






Title


Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intake TP5)  
 Location of ground water level Monitoring Station

Scale	N.T.S	Project No.	MA8001
Date	Mar-10	Figure	4.2c

**CINOTECH**

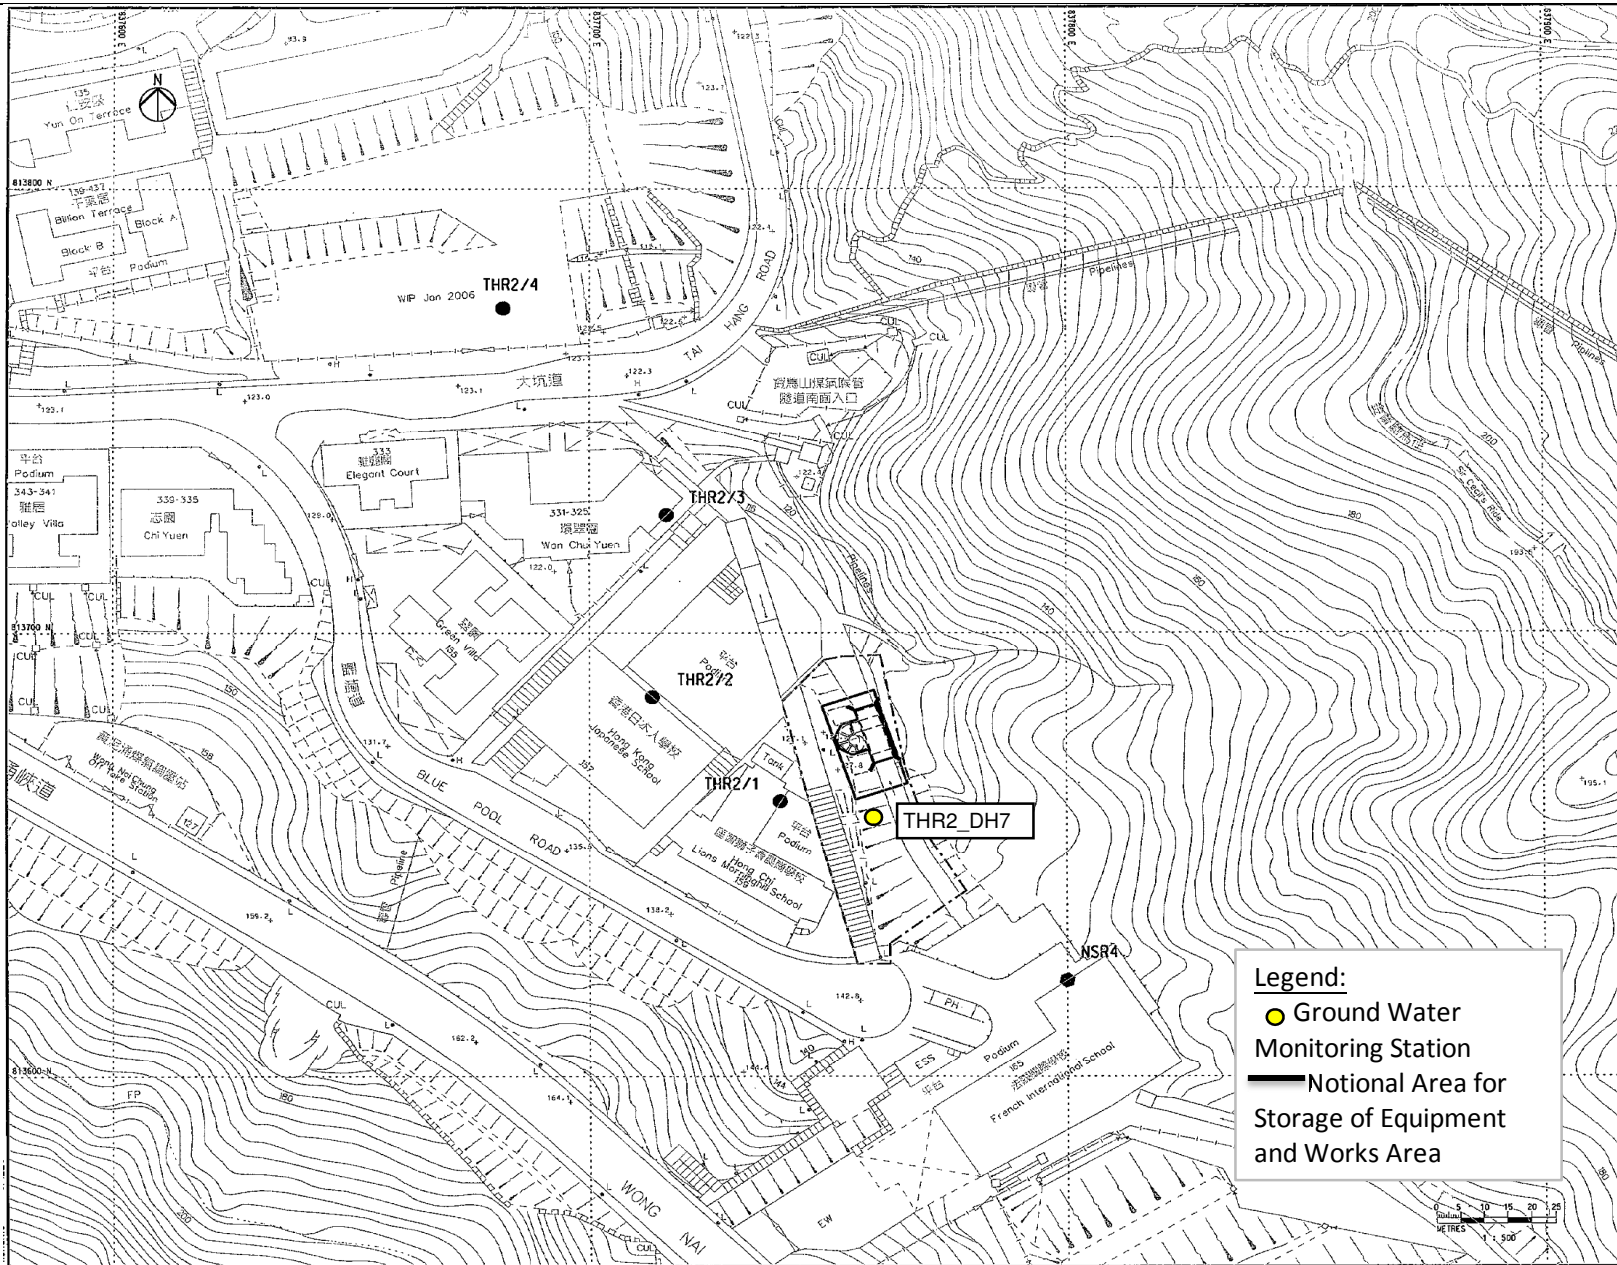

Title	Contract No. DC/2007/10		Scale	Project	CINOTECH
	Design and Construction of Hong Kong West Drainage Tunnel (Intake THR2)		N.T.S	No. MA8001	
	Location of ground water level Monitoring Station		Date	Figure	
			Mar-10	4.2d	

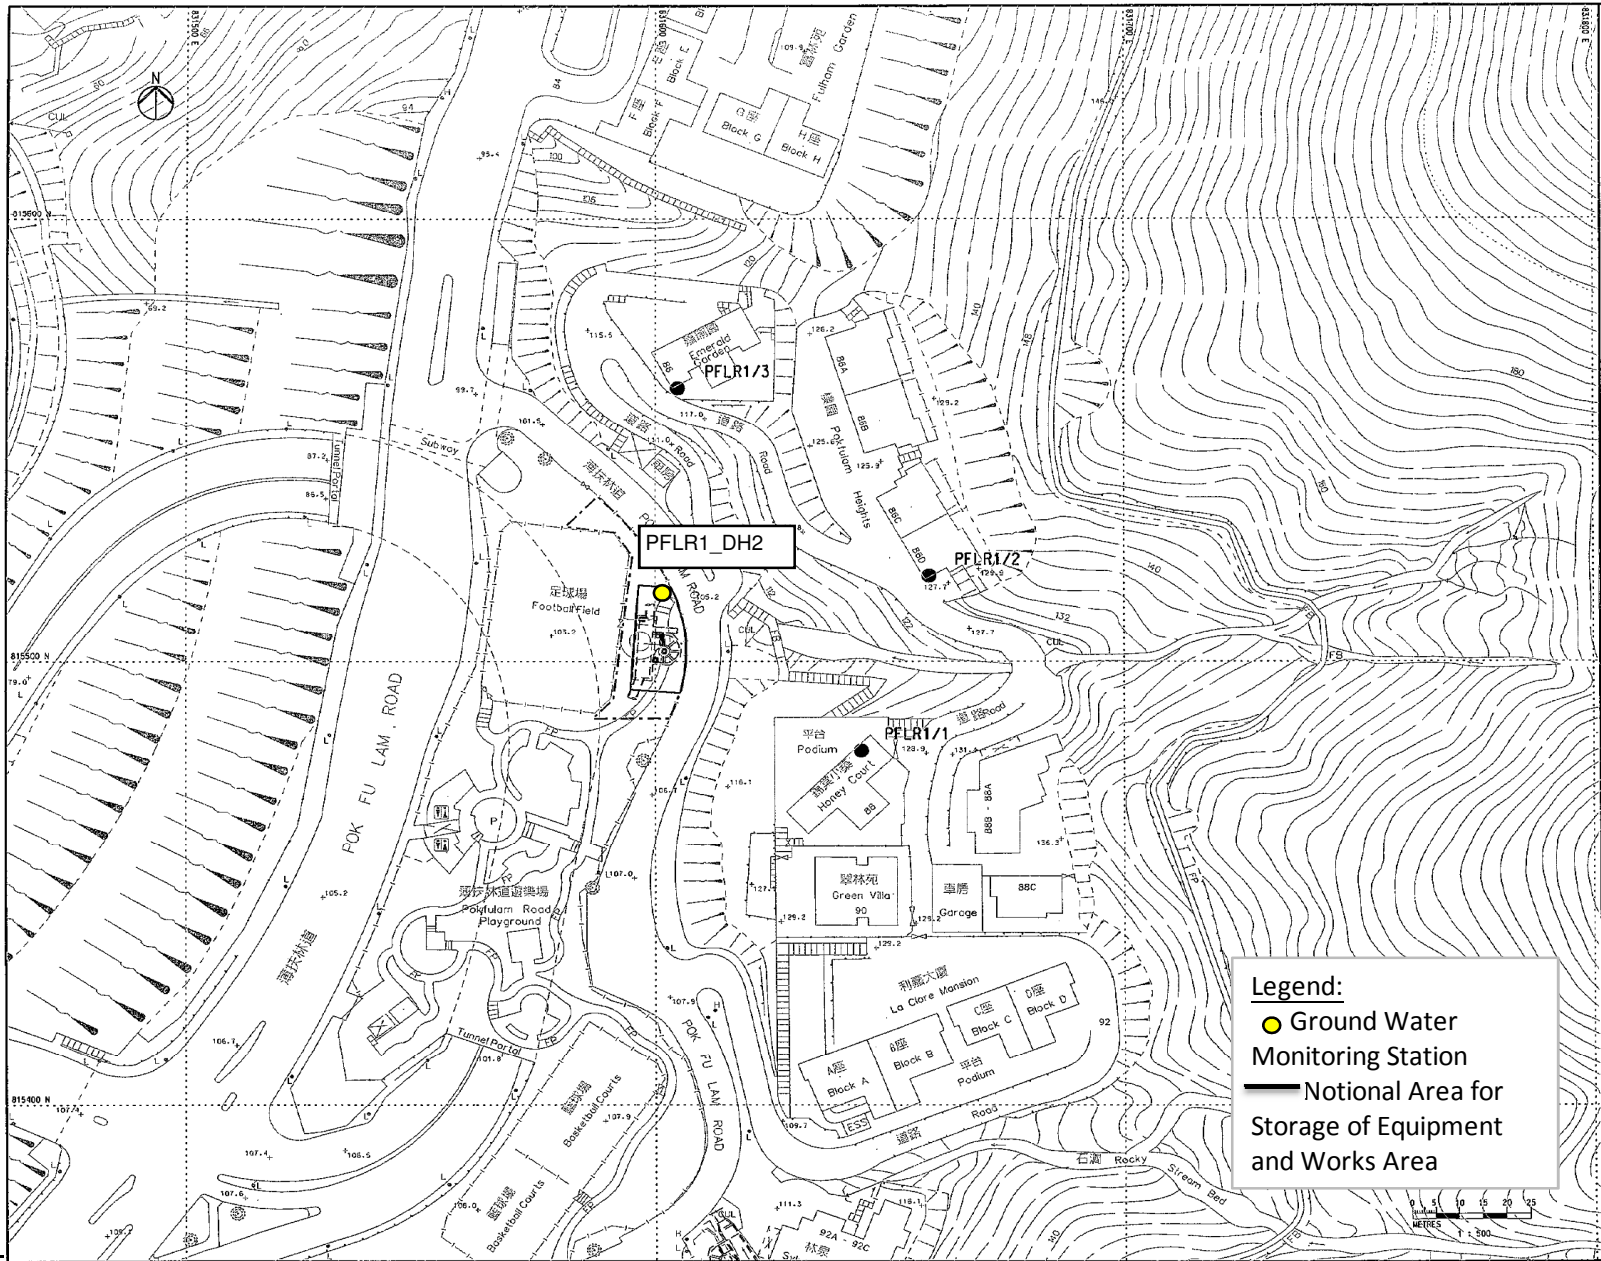

Title

Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 (Intake PFLR1)  
 Location of ground water level Monitoring Station

Scale	N.T.S	Project No.	MA8001
Date	Mar-10	Figure	4.2e

**CINOTECH**

---

---

**APPENDIX A  
CONSTRUCTION PROGRAMME**

---

---

Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>East &amp; West Adit + Intake</b>															
<b>CC01 - PRELIMINARIES &amp; GENERAL REQUIREMENTS</b>															
<b>Milestone</b>															
<b>General</b>															
M1-1790	1.79-Acceptance of Production of Video	0	0		18JUN12*	2	0	0	-173						
M1-1800	1.80-Acceptance of Slope Maintenance Manuals	0	0		18JUN12*	2	0	0	-231						
M1-1810	1.81-GEOCheckingCert.forAll Slopes&RelatingWall	0	0		18JUN12*	2	0	0	-231						
M1-1830	1.83-Approval of Final Operation & Maintenance Manual	0	0		18JUN12*	2	0	0	-173						
M1-1840	1.84-Training for Operation & Maintenance of HKWDT	0	0		18JUN12*	2	0	0	-173						
<b>CC02 - DESIGN &amp; DESIGN CHECKING OF THE WORKS</b>															
<b>Design Stage</b>															
<b>E&amp;M</b>															
D02355	Method Statement Submissions (EP)	30	0	28MAY12A	16JUN12A	2	100	20	-360						
D02360	Statutory Submissions	91	0	25APR11A	16JUN12A	2	100	419	-329						
<b>Milestone</b>															
<b>Design Submission</b>															
M2-1130	2.13-DDA-Dropshaft Submission	0	0		18JUN12	2	0	0	-392						
M2-1250	2.25-Approval of As-built Records of Dropshafts	0	0		18JUN12	2	0	0	-392						
<b>CC03-PART OF SECTION 1 OF THE WORKS(MAIN TUNNEL)</b>															
<b>Construction</b>															
<b>TBM Excavation (Western Tunnel)</b>															
W1340	West Main Tunnel Leaky Cable Sys Instal-(MT)	72	31	16JAN12A	26JUL12	1	25	124	-145						
<b>TBM Excavation (Eastern Tunnel)</b>															
E1665	East Main Tunnel Leaky Cable Sys Instal-(MT)	51	18	21FEB12A	11JUL12	1	75	96	-153						
E1655	Removal of Temp. Tunnel Rail	12	5	16APR12A	25JUN12	1	0	53	-58						
<b>East Portal Finishing Works</b>															
E-1984	East Side - FSD Inspection	24	24	29AUG12	25SEP12	1	0	0	-100						
W1343	West Side - FSD Inspection	24	24	19SEP12	18OCT12	1	0	0	-116						
<b>Milestone</b>															
<b>Section 1 (Main Tunnel)</b>															
M3-1530	3.53-Leaky Cable Communication System	0	0		21AUG12	2	0	0	-456						
M3-1550	3.55-Section1 of the Works related to M.T. to SO	0	0		11JUN12A	2	100	0	-11						
<b>CC04 - PART OF SECTION 1 OF THE WORKS (ADITS)</b>															
<b>Construction</b>															
<b>Adit Tunnel Excavation &amp; Tunnel Lining - sec1</b>															
QL2016	Leaky Cable Installation W0	22	0	17APR12A	14MAY12A	1	100	22	-111						
QL1017	Main Tunnel Insitu Lining - W0	75	0	25FEB12A	30APR12A	1	100	51	-47						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - E5A</b>															
QL207	Leaky Cable Installation E5A	22	0	01MAY12A	23MAY12A	2	100	23	-100						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - E5B</b>															
QL2091	Leaky Cable Installation E5B	8	0	15MAY12A	23MAY12A	1	100	8	-157						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - MB16</b>															
QL215	Leaky Cable Installation MB16	9	0	14MAY12A	19MAY12A	1	100	6	-152						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - MBD2</b>															
QL210	Leaky Cable Installation MBD2	13	0	05MAY12A	19MAY12A	1	100	13	-80						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - E7</b>															
QL224	Leaky Cable Installation E7	17	0	17APR12A	03MAY12A	2	100	17	-140						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - THR2</b>															
QL2291	Leaky Cable Installation THR2	10	0	14MAY12A	19MAY12A	1	100	6	-105						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - GL1</b>															
QL238	Leaky Cable Installation GL1	13	0	07MAY12A	19MAY12A	2	100	13	-53						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - HR1</b>															
QL2341	Leaky Cable Installation HR1	14	0	18MAY12A	02JUN12A	2	100	16	-95						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - DG1</b>															
QL243	Leaky Cable Installation DG1	13	0	17APR12A	29APR12A	2	100	13	-63						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - BR4</b>															
QL096	Junction main tunnel BR4	36	0	20MAR12A	30APR12A	1	100	31	-49						
QL196	Leaky Cable Installation BR4	20	0	10MAY12A	28MAY12A	1	100	16	-52						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - W1</b>															
QL291	Leaky Cable Installation W1	11	0	15MAY12A	19MAY12A	1	100	5	-38						
QL090	Lining W1 (155m)	43	0	21NOV11A	25APR12A	1	100	125	-102						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - BR5</b>															
QL083	Intersection BR6 / BR5 (14m)	29	0	12APR12A	15MAY12A	1	100	27	-57						
QL283	Leaky Cable Installation BR5	6	0	22MAY12A	28MAY12A	1	100	6	-62						
QL0821	Lining BR5 (11m)	4	0	19MAR12A	26APR12A	1	100	30	-72						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - BR6</b>															
QPS145100	Insitu Lining & Grouting, 6m (BR6)	6	0	22MAY12A	26MAY12A	1	100	5	-146						
QL086	Junction main tunnel BR6	36	0	17APR12A	15MAY12A	1	100	23	-66						
QL286	Leaky Cable Installation BR6	25	0	19MAY12A	16JUN12A	1	100	25	-69						
QL0871	Lining BR6 - (from BR5 to Main Tunnel) F1 (178m)	39	0	28MAR12A	20APR12A	1	100	17	-51						
QL0872	Lining BR6 - (from BR5 to Main Tunnel) F2 (178m)	32	0	21APR12A	18MAY12A	1	100	22	-78						
QL081	Stilling chamber Lining - BR6	30	0	07MAR12A	26MAY12A	1	100	64	-152						
QL087	Turning bay BR6	30	0	16MAR12A	24MAY12A	1	100	54	-145						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - W3</b>															
QL278	Leaky Cable Installation W3	20	0	11MAY12A	02JUN12A	1	100	20	-53						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date 30NOV07  
 Finish Date 09FEB13  
 Data Date 19JUN12  
 Run Date 20JUL12 10:22

■ Early Bar  
■ Last Month Progress 205A  
■ Progress Bar  
■ Critical Activity

206A Sheet 1 of 7

**Design & Construction of HK. West Drainage Tunnel**  
 Contract No. DC/2007/10  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C



Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>Adit Tunnel Excavation &amp; Tunnel Lining - W3</b>															
QL079	Turning bay W3	30	0	16FEB12A	26APR12A	1	100	57	-122						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - B2</b>															
QL274	Leaky Cable Installation B2	17	0	22MAY12A	09JUN12A	1	100	17	-72						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - MA14</b>															
QL279	Leaky Cable Installation MA14	8	0	01JUN12A	09JUN12A	1	100	8	-58						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - MA15</b>															
QL266	Leaky Cable Installation MA15	8	0	01JUN12A	09JUN12A	1	100	8	-124						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - MA17</b>															
QL062	Junction main tunnel MA17	36	0	27MAR12A	23APR12A	1	100	20	-37						
QL262	Leaky Cable Installation MA17	8	0	09JUN12A	16JUN12A	1	100	7	-74						
QL061	Lining MA17 (73m)	23	0	28MAR12A	29APR12A	1	100	23	-65						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - M3</b>															
QL258	Leaky Cable Installation M3	8	0	09JUN12A	16JUN12A	1	100	7	-101						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - TP789</b>															
QL254	Leaky Cable Installation TP789	6	0	09JUN12A	13JUN12A	1	100	4	-158						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - TP5</b>															
QL249	Leaky Cable Installation TP5	9	0	09JUN12A	16JUN12A	1	100	7	-176						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - TP4</b>															
QL245	Leaky Cable Installation TP4	7	0	09JUN12A	16JUN12A	1	100	7	-178						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - W5</b>															
QL036	Intersection CR1 / W5	36	17	25MAY12A	10JUL12	1	25	21	-110						
QL039	Junction main tunnel W5	30	0	01MAY12A	14JUN12A	1	100	38	-134						
QL239	Leaky Cable Installation W5	22	22	12JUL12	06AUG12	1	0	0	-132						
QL0382	Lining W5 -CR1 Junction to Main Tunnel F10(153m)	21	18	05JUN12A	11JUL12	1	10	12	-132						
QL034	Stilling chamber Lining - W5	36	0	16APR12A	21MAY12A	1	100	29	-201						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - CR1</b>															
QL2352	Leaky Cable Installation CR1	15	15	09JUL12	25JUL12	1	0	0	-173						
QL040	Turning bay CR1	30	15	15MAY12A	07JUL12	1	10	30	-109						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - RR1</b>															
QL0251	Adit stub Lining	7	7	28JUL12	04AUG12	1	0	0	-185						
QL030	Junction main tunnel RR1	36	36	19JUN12	01AUG12	1	0	0	-126						
QL232	Leaky Cable Installation RR1	17	17	02AUG12	21AUG12	1	0	0	-126						
S260385	Still Chamber Excavation & Enlargement	18	2	18JUL11A	20JUN12	1	95	274	-301						
QL025	Stilling chamber Lining - RR1	30	30	21JUN12	27JUL12	1	0	0	-295						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - W8</b>															
QL027	Intersection RR1 / W8	36	5	22MAY12A	25JUN12	1	85	24	-92						
QL227	Leaky Cable Installation W8	15	15	26JUN12	13JUL12	1	0	0	-92						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - P5</b>															
QL021	Junction main tunnel P5	36	0	05APR12A	22MAY12A	1	100	36	-105						
QL221	Leaky Cable Installation P5	26	26	19JUN12	20JUL12	1	0	0	-128						
QL019	Lining P5 big section 139 m	36	0	17APR12A	22MAY12A	1	100	29	-135						
QL0122	Lining P5 normal 275m W10 - to enlarged Junction	39	0	30MAR12A	29MAY12A	1	100	46	-152						
QL0121	Lining P5 normal 332m up to W10 Junction	55	0	13MAR12A	19MAY12A	1	100	53	-188						
S280580	Stilling Chamber Enlargement-(P5)	18	9	22AUG11A	29JUN12	1	98	244	-277						
QL022	Turning bay P5	30	10	27FEB12A	30JUN12	1	65	91	-248						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - W10</b>															
QL2131	Leaky Cable Installation W10	5	5	19JUN12	25JUN12	1	0	0	-186						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - HKU1</b>															
QL223	Leaky Cable Installation HKU1	15	15	19JUN12	07JUL12	1	0	0	-186						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - PFLR1</b>															
QL204	Leaky Cable Installation PLFR 1	6	0	11JUN12A	16JUN12A	1	100	6	-179						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - SM1</b>															
QL206	Leaky Cable Installation SM1	27	0	17MAY12A	16JUN12A	1	100	27	-114						
<b>Milestone</b>															
<b>Section 1 (Adits)</b>															
M41120	4.012-Junction Between M.Tunnel &Adit(Adit MB16)	0	0		18JUN12	2	0	0	-305						
M41420	4.042-Junction Between M.Tunnel & Adit (Adit W0)	0	0		18JUN12	2	0	0	-110						
M41570	4.057-Junction Between Adit&Adit(Adit BR5)	0	0		10MAY12A	2	100	0	-69						
M41640	4.064-75% Completion of Lining (Adit BR6)	0	0		10MAY12A	2	100	0	-79						
M41650	4.065-100% Lining&Stilling Chamber(Adit BR6)	0	0		10MAY12A	2	100	0	-84						
M41660	4.066-Junction Between M.Tunnel&Adit(Adit BR6)	0	0		10MAY12A	2	100	0	-84						
M41710	4.071-Junction Between M.Tunnel&Adit(AditW3)	0	0		10MAY12A	2	100	0	-65						
M41850	4.085-Junction Between M.Tunnel&Adit(Adit MA17)	0	0		10MAY12A	2	100	0	-65						
M42010	4.101-35% Completion of Lining (Adit W5)	0	0		18JUN12	2	0	0	-247						
M42040	4.104-Junction Between M.Tunnel&Adit(Adit W5)	0	0		10MAY12A	2	100	0	-133						
M42090	4.109-Junction Between Adit and Adit(Adit CR1)	0	0		11JUN12A	2	100	0	-192						
M42100	4.110-50% Completion of Excavation(Adit RR1)	0	0		18JUN12	2	0	0	-390						
M42120	4.112-50% Completion of Lining (Adit RR1)	0	0		10MAY12A	2	100	0	-115						
M42130	4.113-100% Lining&Stilling Chamber(Adit RR1)	0	0		18JUN12	2	0	0	-125						
M42140	4.114-Junction Between M.Tunnel & Adit(Adit RR1)	0	0		01AUG12	2	0	0	-156						
M42190	4.119-Junction Between Adit&Adit (Adit W8)	0	0		10MAY12A	2	100	0	-70						
M42260	4.126-40% Completion of Lining (Adit P5)	0	0		10MAY12A	2	100	0	-291						
M42270	4.127-60% Completion of Lining (Adit P5)	0	0		10MAY12A	2	100	0	-253						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date	30NOV07	Early Bar
Finish Date	09FEB13	Last Month Progress 205A
Data Date	19JUN12	Progress Bar
Run Date	20JUL12 10:22	Critical Activity

206A

Sheet 2 of 7

**Design & Construction of HK. West Drainage Tunnel**  
**Contract No. DC/2007/10**  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C

Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>Section 1 (Adits)</b>															
M42280	4.128-80% Completion of Lining (Adit P5)	0	0		10MAY12A	2	100	0	-211						
M42290	4.129-100% Lining&Stilling Chamber(Adit P5)	0	0		11JUN12A	2	100	0	-205						
M42300	4.130-Junction Between M.Tunnel&Adit(Adit P5)	0	0		11JUN12A	2	100	0	-153						
M42330	4.133-Junction Between Adit&Adit(Adit W10)	0	0		10MAY12A	2	100	0	-219						
M42380	4.138-Junction Between Adit&Adit(Adit HKU1)	0	0		11JUN12A	2	100	0	-242						
M42470	4.147-50% Completion of Lining(Adit SM1)	0	0		18JUN12	2	0	0	-255						
M42500	4.150-Junction Between M.Tunnel&Adit(Adit SM1)	0	0		10MAY12A	2	100	0	-139						
M42510	4.151-Section1 of Works related to adits to SO	0	0		01AUG12	2	0	0	-137						
<b>Adit Tunnel Excavation &amp; Tunnel Lining - HR1</b>															
M151030	15.03-50% Lining (Adit)	0	0		18JUN12	2	0	0	-159						
M151050	15.05-Junction Between Adit&Adit(Adit HR1)	0	0		18JUN12	2	0	0	-125						
<b>CC5-PART OF SECTION 1 OF THE WORKS (EAST PORTAL)</b>															
<b>Construction</b>															
<b>East Portal Assembly Chamber Lining Works</b>															
E-1874	Lining (CH133-163)	67	0	29AUG11A	05MAY12A	1	100	201	-200						
<b>East Portal Maintenance Chamber Finishing Works</b>															
E-1904	Backfill slope	12	12	19JUN12	04JUL12	1	0	0	-231						
E-1902	Cast Center/end/retaining walls	18	0	17MAR12A	06JUN12A	1	100	64	-221						
E-1906	Slab and slope	18	0	19MAY12A	08JUN12A	1	100	18	-193						
E-1910	Wall & Roof slab - Rectangular portion(Ch2-Ch10)	24	0	09JUN12A	19JUN12A	1	100	9	-178						
<b>East Portal River Channel Finishing Works</b>															
E-2069	Access Ramp (B) along River Channel	30	23	11JUN12A	17JUL12	1	15	7	-88						
E-2070	Demolition of upstream cofferdam	26	0	21APR12A	23MAY12A	1	100	26	-43						
<b>East Portal Finishing Works</b>															
E-1830	Access Ramp on Top of RW1 to RW3 Part 1	48	0	12MAR12A	28MAY12A	1	100	61	-247						
E-1832	Access Ramp on Top of RW1 to RW3 Part 2	48	6	29MAY12A	26JUN12	1	25	18	-223						
E-1840	Access Ramp on Top of RW4	50	30	29MAY12A	25JUL12	1	20	18	-197						
E-1943	Builder's Works(UG drainage/Landscaping/Reinst)	90	38	17APR12A	03AUG12	1	50	52	-139						
E-1947	CCTV & Security System Installation	82	31	15MAY12A	26JUL12	1	50	30	-128						
E-1728	DSD Target application last manhole connection	0	0		18JUN12*	1	0	0	-300						
E-1980	Eastern ABWF	62	26	18MAY12A	20JUL12	1	50	27	-144						
E-1949	Electrical Installation	51	35	31MAY12A	31JUL12	1	25	16	-145						
E-1953	FS & Gas Detection Installation	54	30	28MAY12A	25JUL12	1	50	19	-137						
E-1724	FSD (FS501+FS314) Tentative Inspection Date	0	0		18JUN12*	1	0	0	-96						
E-1723	FSD (FS501+FS314)Application for Inspection	0	0		18JUN12*	1	0	0	-112						
E-1722	HEC Tentative Energization date	0	0		18JUN12*	1	0	0	-147						
E-1721	HEC submission & application for permanent power	0	0		18JUN12*	1	0	0	-300						
E-1860	Landscape & Reinstatement-(EP)	77	77	26JUL12	26OCT12	1	0	0	-197						
E-1941	Major E&M Equipment Deliveries	77	35	30APR12A	31JUL12	1	50	42	-226						
E-1951	Mech ventilation & AC installation	38	13	19JUN12	05JUL12	1	0	0	-136						
E-1955	Mechanical & Equipment Installation	69	27	02MAY12A	21JUL12	1	50	41	-100						
E-1730	Permanent Slope Works	60	6	21FEB12A	26JUN12	1	75	96	-134						
E-1945	Plumbing and Drainage System Installation	52	15	09MAY12A	07JUL12	1	50	35	-142						
E-1940	Slope & Drainage Works	60	60	26JUL12	05OCT12	1	0	0	-197						
E-12729	Stoplog submission	0	0		18JUN12*	1	0	0	-275						
E-1726	WSD Submission & Application for permanent Water	0	0		18JUN12*	1	0	0	-300						
E-1727	WSD Tentative Permanent Water Supply	0	0		18JUN12*	1	0	0	-123						
<b>Western Portal Finishing Works</b>															
E-1982	T&C East Portal	24	24	01AUG12	28AUG12	1	0	0	-100						
<b>Milestone</b>															
<b>Section 1 (Eastern Portal)</b>															
M5-1020	5.02-Concrete Structure(River Channel Structure)	0	0		18JUN12	2	0	0	-138						
M5-1040	5.04-Excavation(Access Ramp)	0	0		25JUL12	2	0	0	-246						
M5-1050	5.05-Concrete Structure(Access Ramp)	0	0		11JUN12A	2	100	0	-76						
M5-1100	5.10-Lining(Maintenance Chamber)	0	0		10MAY12A	2	100	0	-182						
M5-1110	5.11-Mechanical&Electrical Installation(MC)	0	0		11JUN12A	2	100	0	-129						
<b>CC6-PART OF SECTION 1 OF THE WORKS (WEST PORTAL)</b>															
<b>Construction</b>															
<b>Western Portal Finishing Works</b>															
WPR271	Access ramp	20	12	14MAY12A	04JUL12	1	0	31	-137						
WPR232	Access ramp - base slab & parapet	20	20	05JUL12	27JUL12	1	0	0	-97						
WPR256	Dismantle noise enclosure and Adit equipment	21	12	16MAY12A	04JUL12	1	50	29	-126						
WPR144	Handover Rect Trans Tunnel Adit Muck(Stg1) works	0	0	14MAY12A		1	100	0	-150						
WPR254	Intermediate wall in Arch Tunnel	30	6	19MAR12A	26JUN12	1	50	73	-121						
WPR225	Rect Trans Structure (Ch10,609-Ch10,596) R2	36	0	08MAY12A	18JUN12A	1	100	36	-79						
WPR222	Rect Trans Structure (Ch10,622-Ch10,609) R1	36	36	28JUN12	09AUG12	1	0	0	-158						
WPR264	Reinstatement Final Finishing & Lanscaping	28	28	17JUL12	17AUG12	1	0	0	-126						
WPR142	Reprovisioning works ( After ADIT excavation)	30	7	12MAR12A	27JUN12	1	60	79	-158						
WPR267	Sea works	38	0	17APR12A	18JUN12A	1	100	52	-68						
WPR147	Site demolition	30	7	12MAR12A	27JUN12	1	60	79	-158						
WPR258	Slope works & Retaining wall	36	36	21JUN12	03AUG12	1	0	0	-126						
WPR265	T&C West Portal	24	24	22AUG12	18SEP12	1	0	0	-116						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date	30NOV07
Finish Date	09FEB13
Data Date	19JUN12
Run Date	20JUL12 10:22

	Early Bar
	Last Month Progress 205A
	Progress Bar
	Critical Activity

206A

Sheet 3 of 7

**Design & Construction of HK, West Drainage Tunnel**  
**Contract No. DC/2007/10**  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C

Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>Western Portal Finishing Works</b>															
WPR242	West Side - FSD Inspection	24	24	19SEP12	18OCT12	1	0	0	-116						
<b>Milestone</b>															
<b>Section 1 (Western Portal)</b>															
M6-1060	6.05-Concrete Structure (RTT)	0	0		18JUN12	2	0	0	-100						
M6-1070	6.06-Backfilling&Reinstatement (RTT)	0	0		11JUN12A	2	100	0	-93						
M6-1100	6.09-Access Ramp	0	0		11JUN12A	2	100	0	-76						
M6-1110	6.10-Rock Armour	0	0		04JUL12	2	0	0	-103						
<b>CC8 - SECTION 2 OF THE WORKS (PORTION E5A)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS020293	Finishing works / PS BW / Reinstatement (E5A)	18	18	17JUL12	06AUG12	1	0	0	-78						
QHS020100	Local Intake Test & Commissioning - (E5A)	12	6	18MAY12A	26JUN12	1	75	27	-129						
QHS020291	VO Backdrop manholes & drains at LKS side - E5A	54	33	18APR12A	28JUL12	1	50	51	-78						
QHS020290	Water Mains diversion by othrs+Mod SiteSetup E5A	24	19	14MAY12A	12JUL12	1	10	31	-118						
<b>Milestone</b>															
<b>General</b>															
M81070	08.07-Section2 - E5A Handover to SO	0	0		06AUG12	2	0	0	-94						
<b>Section 2 (Portion E5A)</b>															
M81050	8.05-Concrete Structure (Intake)	0	0		28JUL12	2	0	0	-95						
M81060	8.06-Slopeworks, Backfilling & Reinstatement	0	0		06AUG12	2	0	0	-94						
<b>CC11-SECTION 5 OF THE WORKS (PORTION MBD2)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QH050100	Local Intake Test & Commissioning - MBD2	12	10	19JAN12A	30JUN12	1	10	121	-227						
<b>Pipe Laying</b>															
QH050107	Carriageway and Permanent Reinstatement	18	18	22JUN12	14JUL12	1	0	0	-149						
QH050105	Remain Drain works MBD2-SMH13 - Part 3	37	3	31MAR12A	21JUN12	1	90	62	-183						
<b>Milestone</b>															
<b>General</b>															
M11-1080	11.08-Section5 MBD2 Handover to SO	0	0		14JUL12	2	0	0	-186						
<b>Section 5 (Portion MBD2)</b>															
M11-1060	11.06-Drainage Works & Reinstatement(D.Works)	0	0		14JUL12	2	0	0	-186						
<b>CC12-SECTION 6 OF THE WORKS (PORTION E7)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS060266	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(E7)	33	11	16MAY12A	03JUL12	1	90	29	-133						
QHS060267	Finishing works / PS BW / Reinstatement (E7)	18	18	04JUL12	24JUL12	1	0	0	-133						
QHS060265	Intake Permanent Structure(6 pours) (E7)	64	0	24FEB12A	15MAY12A	1	100	64	-149						
QHS060100	Local Intake Test & Commissioning - (E7)	12	12	19JUN12	04JUL12	1	0	0	-134						
QHS060263	Penstock Delivery - (E7)	0	0	19JUN12*		1	0	0	-174						
<b>Pipe Laying</b>															
QHS060280	VO15-Stag 3cExcav/ELS&ConsSMH14(Downstream) (E7)	92	29	15DEC11A	24JUL12	1	60	148	-118						
<b>Milestone</b>															
<b>General</b>															
M121080	12.08-Section6 - E7 Handover to SO	0	0		11JUN12A	2	100	0	-104						
<b>Section 6 (Portion E7)</b>															
M121050	12.05-Concrete Structure (Intake)	0	0		03JUL12	2	0	0	-168						
M121060	12.06-Drainage Works&Reinstatement (D.Works)	0	0		24JUL12	2	0	0	-147						
M121070	12.07-Slopeworks, Backfilling & Reinstatement	0	0		10MAY12A	2	100	0	-90						
<b>CC15-SECTION9 OF THE WORKS(PORTION HR1)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QPS090271	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(HR1)	36	0	16MAR12A	25MAY12A	1	100	55	-138						
QPS09272	Finishing works / PS BW / Reinstatement (HR1)	18	27	26MAY12A	21JUL12	1	75	20	-167						
QHS090100	Local Intake Test & Commissioning - (HR1)	12	12	19JUN12	04JUL12	1	0	0	-170						
QPS090269	Penstock Delivery - (HR1)	0	0	19JUN12*		1	0	0	-244						
<b>Milestone</b>															
<b>General</b>															
M151120	15.12-Section9 - HR1 Handover to SO	0	0		11JUN12A	2	100	0	-171						
<b>Section 9 (Portion HR1)</b>															
M151100	15.10-Concrete Structure (Intake)	0	0		10MAY12A	2	100	0	-160						
M151110	15.11-Slopeworks, Backfilling & Reinstatement	0	0		21JUL12	2	0	0	-211						
<b>CC16-SECTION 10 OF THE WORKS (PORTION DG1)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS100381	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(DG1)	33	0	26MAR12A	18JUN12A	1	100	67	-191						
QHS100382	Finishing works / PS BW / Reinstatement (DG1)	22	22	19JUN12	16JUL12	1	0	0	-195						
QHS100100	Local Intake Test & Commissioning - (DG1)	12	12	19JUN12	04JUL12	1	0	0	-203						
QHS100280	Penstock Delivery - (DG1)	0	0	19JUN12*		1	0	0	-244						
<b>Milestone</b>															
<b>General</b>															
M16-1070	16.07-Section 10 - DG1 Handover to SO	0	0		11JUN12A	2	100	0	-209						
<b>Section 10 (Portion DG1)</b>															
M16-1050	16.05-Concrete Structure (Intake)	0	0		18JUN12	2	0	0	-237						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date	30NOV07	Early Bar
Finish Date	09FEB13	Last Month Progress 205A
Data Date	19JUN12	Progress Bar
Run Date	20JUL12 10:22	Critical Activity

206A  
 Sheet 4 of 7  
**Design & Construction of HK, West Drainage Tunnel**  
 Contract No. DC/2007/10  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C

Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>CC7 - PART OF SECTION 1 OF THE WORKS (PORTION W0)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QH3334	BS/Vortex/Penstock/Drain Dvn/TS Stage 2- (W0)	33	0	13FEB12A	03MAY12A	1	100	64	-75						
QH3335	Finishing works / PS BW / Reinstatement (W0)	67	17	04MAY12A	13JUL12	1	75	39	-85						
QH3336	Intake Backfill and compression - W0	3	3	19JUN12	21JUN12	1	0	0	-153						
QH010100	Local Intake Test & Commissioning - (W0)	12	12	17APR12A	07JUL12	1	0	52	-129						
QH3330	Penstock Delivery - (W0)	0	0	19JUN12*		1	0	0	-174						
<b>Milestone</b>															
<b>General</b>															
M7-1090	7.09-Section1 of Works within Portion WO to SO	0	0		10MAY12A	2	100	0	-44	◆MC (135)					
<b>Section 1(W0,Adits,East &amp; West Portal,Main Tunnl)</b>															
M7-1050	7.05-Lining(Access Shaft)	0	0		18JUN12	2	0	0	-265	◆					
M7-1070	7.07-Concrete Structure (Intake)	0	0		21JUN12	2	0	0	-143	◆					
M7-1080	7.08-Slopework, Backfilling & Reinstatement	0	0		13JUL12	2	0	0	-108	◆					
<b>CC17-SECTION 11 OF THE WORKS (PORTION BR4)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS1104363	Dismantle Loading Platform + Reinstatement (BR4)	51	0	02APR12A	11JUN12A	1	100	55	-37						
QHS1104361	Dismantle OHC (BR4)	12	0	18APR12A	04MAY12A	1	100	13	-56						
QHS170100	Local Intake Test & Commissioning - (BR4)	12	0	17APR12A	02MAY12A	1	100	12	-66						
<b>Milestone</b>															
<b>General</b>															
M171070	17.07-Section11 - BR4 Handover to SO	0	0		18JUN12	2	0	0	-53	◆					
<b>CC18-SECTION 12 OF THE WORKS (PORTION W1)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS120224	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(W1)	36	0	21JAN12A	20APR12A	1	100	71	-50						
QHS120225	Finishing works / PS BW / Reinstatement (W1)	27	31	21APR12A	26JUL12	1	10	48	-111						
QHS120100	Local Intake Test & Commissioning - (W1)	12	0	21APR12A	05MAY12A	1	100	11	-61						
<b>Milestone</b>															
<b>General</b>															
M181070	18.07-Section12 - W1 Handover to SO	0	0		26JUL12	2	0	0	-139	◆					
<b>CC19-SECTION 13 OF WORKS (PORTION BR5)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QSH130301	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(BR5)	33	0	03MAR12A	15MAY12A	1	100	57	-80						
QSH130302	Finishing works / PS BW / Reinstatement (BR5)	18	21	16MAY12A	14JUL12	1	90	29	-112						
QHS130100	Local Intake Test & Commissioning - (BR5)	12	12	19JUN12	04JUL12	1	0	0	-121						
QSH130299	Penstock delivery - (BR5)	0	0	19JUN12*		1	0	0	-174						
<b>Milestone</b>															
<b>General</b>															
M19-1070	19.07-Section13 - BR5 Handover to SO	0	0		10MAY12A	2	100	0	-75	◆MC (135)					
<b>CC20-SECTION 14 OF THE WORKS (PORTION BR6)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS140299	Finishing works / PS BW / Reinstatement (BR6)	36	25	28JAN12A	19JUL12	1	95	116	-182						
QHS140100	Local Intake Test & Commissioning - (BR6)	12	0	09FEB12A	19APR12A	1	100	57	-144						
QHS140296	Penstock Delivery - (BR6)	0	0	19JUN12*		1	0	0	-244						
<b>Pipe Laying</b>															
S140209	Construct Manhole SMH17	29	0	17APR12A	22MAY12A	1	100	29	-91						
S140210	Footpath Reinstatement	15	15	19JUN12	07JUL12	1	0	0	-114						
S140340	Pipeline & MH construction SMH17 to BR7	64	11	08FEB12A	03JUL12	1	75	107	-160						
<b>Milestone</b>															
<b>Section 14 (Portion BR6)</b>															
M201030	20.03-Lining (Dropshaft)	0	0		11JUN12A	2	100	0	-200	◆MC (136)					
M201070	20.07-100% P.Length of Trenchless Drainage Works	0	0		10MAY12A	2	100	0	-212	◆MC (135)					
M201080	20.08-Slopeworks, Backfilling and Reinstatement	0	0		19JUL12	2	0	0	-229	◆					
<b>CC21-SECTION 15 OF THE WORKS (PORTION W3)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS150207	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(W3)	36	0	17FEB12A	04MAY12A	1	100	61	-49						
QHS150208	Finishing works / PS BW / Reinstatement (W3)	18	27	05MAY12A	21JUL12	1	0	38	-96						
QHS210100	Local Intake Test & Commissioning - (W3)	12	3	09MAY12A	21JUN12	1	75	35	-90						
QL076	Stilling chamber Lining - (W3)	30	0	27DEC11A	18MAY12A	1	100	114	-169						
<b>Milestone</b>															
<b>General</b>															
M211070	21.07-Section15 - W3 Handover to SO	0	0		10MAY12A	2	100	0	-49	◆MC (135)					
<b>Section 15 (Portion W3)</b>															
M211050	21.05-Concrete Structure (Intake)	0	0		10MAY12A	2	100	0	-70	◆MC (135)					
<b>CC22-SECTION 16 OF THE WORKS (PORTION B2)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS160126	Finishing works / PS BW / Reinstatement (B2)	17	0	15FEB12A	26MAY12A	1	100	82	-72						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date 30NOV07  
Finish Date 09FEB13  
Data Date 19JUN12  
Run Date 20JUL12 10:22

■ Early Bar  
■ Last Month Progress 205A  
■ Progress Bar  
■ Critical Activity

206A  
Sheet 5 of 7  
**Design & Construction of HK, West Drainage Tunnel**  
**Contract No. DC/2007/10**  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C

Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>CC23-SECTION 17 OF THE WORKS (PORTION MA14)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS170474	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(M14)	36	0	01MAR12A	20APR12A	1	100	40	-44						
QHS170477	Dismantling of Overhead Gantry Crane (MA14)	7	0	28MAY12A	13JUN12A	1	100	15	-70						
QHS170478	Dismantling of Steel Deck (MA14)	10	0	05JUN12A	13JUN12A	1	100	8	-60						
QHS170476	Finishing works / PS BW / Reinstatement (MA14)	18	0	21APR12A	18JUN12	1	0	48	-74						
QHS170101	Local Intake Test & Commissioning - (M14)	12	0	22MAY12A	04JUN12A	1	100	12	-80						
QHS170472	Penstock Delivery - (M14)	0	0	19JUN12*		1	0	0	-135						
<b>Milestone</b>															
<b>General</b>															
M23-1080	23.08-Section17 - MA14 Handover to SO	0	0		18JUN12	2	0	0	-82						
<b>CC25-SECTION 19 OF THE WORKS (PORTION MA17)</b>															
<b>Construction</b>															
<b>Dropshaft - Excavation/ Shaft Lining</b>															
QPS190340	Dropshaft-Position,Fix&Grout -117.3m ID2.3(MA17)	48	0	16APR12A	19MAY12A	1	100	28	-65						
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS190511	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(MA17)	30	26	21MAY12A	20JUL12	1	50	25	-26						
QHS190513	Dismantle Overhead Gantry Crane (MA17)	7	7	11AUG12	18AUG12	1	0	0	-26						
QHS190512	Finishing works / PS BW / Reinstatement (MA17)	32	32	13JUL12	18AUG12	1	0	0	-26						
QHS190100	Local Intake Test & Commissioning - (MA17)	12	12	07JUL12	20JUL12	1	0	0	-26						
QHS190510	Penstock Delivery - (MA17)	0	0	19JUN12*		1	0	0	-135						
<b>Milestone</b>															
<b>General</b>															
M25-1070	25.07-Section19 - MA17 Handover to SO	0	0		11JUN12A	2	100	0	38						
<b>Section 19 (Portion MA17)</b>															
M25-1030	25.03-Lining (Dropshaft)	0	0		10MAY12A	2	100	0	-73						
M25-1050	25.05-Concrete Structure (Intake)	0	0		11JUN12A	2	100	0	7						
M25-1060	25.06-Slopeworks, Backfilling & Reinstatement	0	0		18AUG12	2	0	0	-30						
<b>CC26-SECTION 20 OF THE WORKS (PORTION M3)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS200414	Finishing works / PS BW / Reinstatement (M3)	15	0	03APR12A	05JUN12A	1	100	49	-67						
QHS200100	Local Intake Test & Commissioning - (M3)	12	0	21APR12A	07MAY12A	1	100	12	-50						
QHS200410	Penstock Delivery - (M3)	0	0	19JUN12*		1	0	0	-174						
<b>CC28-SECTION 22 OF THE WORKS (PORTION TP5)</b>															
<b>Milestone</b>															
<b>General</b>															
M28-1070	28.07-Section22 - TP5 Handover to SO	0	0		18JUN12	2	0	0	-262						
<b>CC30-SECTION 24 OF THE WORKS (PORTION W5)</b>															
<b>Construction</b>															
<b>Intakes - External Structures (Stage1)</b>															
QHS240345	Intake Structure (8 pours) Stage 1 (W5)	89	0	21FEB12A	23MAY12A	1	100	74	-143						
<b>Dropshaft - Excavation/ Shaft Lining</b>															
QPS240550	Dropshaft-Position,Fix&Grout- 25m ID2.3 (W5)	14	0	19MAY12A	08JUN12A	1	100	18	-143						
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS240346	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(W5)	36	36	19JUN12	01AUG12	1	0	0	-151						
QHS240347	Finishing works / PS BW / Reinstatement (W5)	18	18	02AUG12	22AUG12	1	0	0	-151						
QHS240100	Local Intake Test & Commissioning - (W5)	12	12	19JUL12	01AUG12	1	0	0	-151						
<b>Milestone</b>															
<b>General</b>															
M301070	30.07-Section24 - W5 Handover to SO	0	0		22AUG12	2	0	0	-186						
<b>Section 24 (Portion W5)</b>															
M301030	30.03-Lining (Dropshaft)	0	0		11JUN12A	2	100	0	-184						
M301050	30.05-Concrete Structure (Intake)	0	0		01AUG12	2	0	0	-186						
M301060	30.06-Slopeworks, Backfilling & Reinstatement	0	0		22AUG12	2	0	0	-186						
<b>CC31-SECTION 25 OF THE WORKS (PORTION CR1)</b>															
<b>Construction</b>															
<b>Intakes - External Structures (Stage1)</b>															
S250300	Cofferdam Excav,ELS & Drain Divn -(CR1)	52	20	26MAY12A	13JUL12	1	75	20	-241						
<b>Dropshaft - Excavation/ Shaft Lining</b>															
QS250546	Back Reaming & Demobilization - (CR1)	29	0	11APR12A	20MAY12A	1	100	32	-110						
QPS250310	Dropshaft-Position,Fix&Grout - 99.2m ID1.5 (CR1)	31	31	14JUL12	18AUG12	1	0	0	-109						
QS250530	RB Setup/Reaming/Demobilization(CR1) (99m)	47	0	27JAN12A	20MAY12A	1	100	92	-110						
QL033	Stabilisation shaft CR1	6	0	21MAY12A	25MAY12A	1	100	5	-109						
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS250327	Intake Peramanent Structure(5 pours) Stage 1CR1	40	40	20AUG12	06OCT12	1	0	0	-180						
QHS250326	Penstock Delivery - (CR1)	0	0	19JUN12*		1	0	0	-135						
<b>Milestone</b>															
<b>Section 25 (Portion CR1)</b>															
M31-1030	31.03-Lining (Dropshaft)	0	0		18AUG12	2	0	0	-135						
M31-1040	31.04-Excavation (Intake)	0	0		13JUL12	2	0	0	-300						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date 30NOV07  
Finish Date 09FEB13  
Data Date 19JUN12  
Run Date 20JUL12 10:22

- █ Early Bar
- █ Last Month Progress 205A
- █ Progress Bar
- █ Critical Activity

206A Sheet 6 of 7  
**Design & Construction of HK, West Drainage Tunnel**  
Contract No. DC/2007/10  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C

Act ID	Activity Description	Orig Dur	Rem Dur	Anticipated Start	Anticipated Finish	Cal ID	% Comp	Actual Duration	Works Prog # 6 WP6C EF Variance	2012					
										APR	MAY	JUN	JUL	AUG	SEP
<b>CC32-SECTION 26 OF THE WORKS (PORTION RR1)</b>															
<b>Construction</b>															
<b>Intakes - External Structures (Stage1)</b>															
QHS260374	Stage 1 structure (5 pours) with VO - (RR1)	62	0	09DEC11A	18JUN12A	1	100	153	-213						
<b>Dropshaft - Excavation/ Shaft Lining</b>															
QPS260580	Dropshaft-Position,Fix & Grout -72.8m ID1.5 (RR1)	23	23	28JUL12	23AUG12	1	0	0	-245						
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS260375	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(RR1)	33	33	24AUG12	03OCT12	1	0	0	-245						
QHS260100	Local Intake Test & Commissioning - (RR1)	12	12	18SEP12	03OCT12	1	0	0	-245						
<b>Milestone</b>															
<b>Section 26 (Portion RR1)</b>															
M32-1030	32.03-Lining (Dropshaft)	0	0		23AUG12	2	0	0	-302						
<b>CC33-SECTION 27 OF THE WORKS (PORTION W8)</b>															
<b>Construction</b>															
<b>Dropshaft - Excavation/ Shaft Lining</b>															
QPS270440	Dropshaft-Position,fix & Grout - 31.5m ID1.5(W8)	15	0	31MAR12A	30APR12A	1	100	21	-124						
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS270389	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(W8)	36	36	19JUN12	01AUG12	1	0	0	-85						
QHS270391	Dismantle OHC (W8)	7	7	15AUG12	22AUG12	1	0	0	-85						
QHS270390	Finishing works / PS BW / Reinstatement (W8)	18	18	02AUG12	22AUG12	1	0	0	-85						
QHS270386	Intake Permanent Structure(3 pour) Stage 1b (W8)	21	0	30MAY12A	18JUN12A	1	100	17	-85						
QHS270388	Intake Permanent Structure(4 pour) Stage 1a (W8)	50	0	02MAY12A	29MAY12A	1	100	24	-98						
QHS270100	Local Intake Test & Commissioning - (W8)	12	12	19JUL12	01AUG12	1	0	0	-85						
QHS270387	Penstock Delivery - (W8)	0	0	19JUN12*		1	0	0	-135						
<b>Milestone</b>															
<b>General</b>															
M33-1070	33.07-Section27 - W8 Handover to SO	0	0		22AUG12	2	0	0	-102						
<b>Section 27 (Portion W8)</b>															
M33-1010	33.01-Pre-drilling & Grouting Works (Dropshaft)	0	0		18JUN12	2	0	0	-230						
M33-1030	33.03-Lining (Dropshaft)	0	0		10MAY12A	2	100	0	-168						
M33-1050	33.05-Concrete Structure (Intake)	0	0		01AUG12	2	0	0	-104						
M33-1060	33.06-Slopedworks, Backfilling & Reinstatement	0	0		22AUG12	2	0	0	-102						
<b>CC34-SECTION 28 OF THE WORKS (PORTION P5)</b>															
<b>Construction</b>															
<b>Intakes - External Structures (Stage1)</b>															
QHS280118	Cofferdam Excav+ELS+Temp Divern to+95.6mPD -(P5)	98	20	17DEC11A	13JUL12	1	50	146	-172						
QHS280120	Construct Intake Stage 1 (8 pours)- (P5)	81	81	14JUL12	18OCT12	1	0	0	-172						
QHS280123	Shaft Remedial works(Mech Excav still chbr)(P5)	46	46	04JUL12	25AUG12	1	0	0	-174						
QHS280122	Shaft Remedial works(rock dowel&Grabbing)(P5)	99	11	16NOV11A	03JUL12	1	60	173	-174						
QL012	Stilling chamber Lining - P5	36	36	27AUG12	09OCT12	1	0	0	-174						
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS280115	Penstock Delivery (P5)	0	0	19JUN12*		1	0	0	-135						
<b>Milestone</b>															
<b>Section 28 (Portion P5)</b>															
M341010	34.01-Pre-drilling & Grouting Works (Dropshaft)	0	0		18JUN12	2	0	0	-310						
M341040	34.04-Excavation (Intake)	0	0		11JUN12A	2	100	0	-185						
<b>CC35-SECTION 29 OF THE WORKS (PORTION W10)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS290371	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(W10)	33	20	05MAR12A	13JUL12	1	20	85	-160						
QHS290373	Dismantling of OHC steel frame (W10)	5	5	04AUG12	09AUG12	1	0	0	-160						
QHS290372	Finishing works / PS BW / Reinstatement (W10)	18	18	14JUL12	03AUG12	1	0	0	-160						
QHS290100	Local Intake Test & Commissioning - (W10)	12	12	29JUN12	13JUL12	1	0	0	-160						
<b>Milestone</b>															
<b>General</b>															
M351070	35.07-Section29 - W10 Handover to SO	0	0		09AUG12	2	0	0	-196						
<b>Section 29 (Portion W10)</b>															
M351050	35.05-Concrete Structure (Intake)	0	0		03AUG12	2	0	0	-199						
M351060	35.06-Slopedworks, Backfilling & Reinstatement	0	0		09AUG12	2	0	0	-196						
<b>CC37-SECTION 31 OF THE WORKS (PORTION PFLR1)</b>															
<b>Construction</b>															
<b>Intakes - Internal Structures (Stage 2)</b>															
QHS311009	BS/Vortex/Penstock/Drain Dvn/TS - Stage 2(PFLR1)	33	0	02FEB12A	02MAY12A	1	100	72	-112						
QHS311010	Finishing works / PS BW / Reinstatement (PFLR1)	60	26	03MAY12A	20JUL12	1	75	40	-118						
QHS310100	Local Intake Test & Commissioning - (PFLR1)	12	15	18JUN12A	07JUL12	1	10	1	-167						
<b>Milestone</b>															
<b>Section 31 (Portion PFLR1)</b>															
M371060	37.06-Slopedworks, Backfilling & Reinstatement	0	0		10MAY12A	2	100	0	-76						
<b>CC39-SECTION 34 OF THE WORKS(MGMT &amp; MAINTENANCE)</b>															
<b>Milestone</b>															
<b>Section 34(Mgmt &amp; Maintenance of As-ConstnStruct)</b>															
M39-1010	39.01-Section34 of Works to Supervising Officer	0	0		18JUN12*	2	0	0	-110						

APR	MAY	JUN	JUL	AUG	SEP
2012					

Start Date 30NOV07  
Finish Date 09FEB13  
Data Date 19JUN12  
Run Date 20JUL12 10:22

■ Early Bar  
■ Last Month Progress 205A  
■ Progress Bar  
■ Critical Activity

206A  
Sheet 7 of 7  
**Design & Construction of HK. West Drainage Tunnel**  
**Contract No. DC/2007/10**  
**3 MONTH ROLLING PROGRAMME**  
**JUNE /2012 MONTHLY REPORT**

WORKS PROGRAMME APPROVAL HISTORY			
Date	Revision	Checked	Approved
13JAN09	Approved Works Programme # 1	SOR	804B
27MAR09	Approved Works Programme # 2	SOR	9032
10DEC10	Approved Works Programme # 3	SOR	9116
01MAR10	Approved Works Programme # 4	SOR	003A
25FEB11	Approved Works Programme # 5	SOR	301F
29JUN11	Approved Works Programme # 6	SOR	WP6C

---

---

**APPENDIX B  
MONITORING REQUIREMENTS**

---

---

**Appendix B - Environmental Impact Monitoring Requirements**

Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
Air Quality	1 hour TSP	Three times / 6 days	<ul style="list-style-type: none"> <li>• AQ1 (True Light Middle School of Hong Kong)</li> <li>• AQ2 (Outside Aegean Terrace)</li> </ul>	AQ1 – Canopy AQ2 – Roadside AQ3 – Roadside
	24 hour TSP	Once / 6 days	<ul style="list-style-type: none"> <li>• AQ1 (True Light Middle School of Hong Kong)</li> <li>• AQ3 (Outside Site Office at Western Portal)</li> </ul>	



Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
Airborne Noise	$L_{eq}$ , $L_{90}$ & $L_{10}$ at 30 minute intervals during (0700 to 1900 on normal weekdays)	Once per week	<ul style="list-style-type: none"> <li>• NC1 (True Light Middle School of Hong Kong)</li> <li>• NC2 (The Legend)</li> <li>• NC3 (Outside Aegean Terrace)</li> <li>• NC4 (Man Yuen Garden)</li> <li>• NC5 (Blk D Villa Monte Rosa)</li> <li>• NC6 (Rosaryhill School)</li> <li>• NC7 (Buddist Li Ka Shing Care &amp; Attention Home for the Elderly)</li> <li>• NC8 (Marymount Secondary School)</li> <li>• NC9 (117 Blue Pool Road)</li> <li>• NC10 (The Harbour View)</li> <li>• NC11 (Honey Court)</li> <li>• NC12 (Ying Wa Girl's School)</li> <li>• NC13 (Peaksville Court)</li> <li>• NC14 (Hong Kong Japanese School)</li> <li>• NC15a (12 Tung Shan Terrace)</li> <li>• NC16 (Raimondi College)</li> <li>• NC17 (Hong Kong Institute of</li> </ul>	<ul style="list-style-type: none"> <li>• NC1 - Facade measurement</li> <li>• NC2 - Facade measurement</li> <li>• NC3 - Facade measurement</li> <li>• NC4 - Facade measurement</li> <li>• NC5 - Free field measurement</li> <li>• NC6 - Facade measurement</li> <li>• NC7 - Facade measurement</li> <li>• NC8 – Facade measurement</li> <li>• NC9 – Facade measurement</li> <li>• NC10 – Facade measurement</li> </ul>

Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
			Technology) • NC18 (Blk A, 80 Robinson Road) • NC19 (Villa Veneto)	<ul style="list-style-type: none"> <li>• NC11 – Free field measurement</li> <li>• NC12 - Facade measurement</li> <li>• NC13 - Facade measurement</li> <li>• NC14 - Facade measurement</li> <li>• NC15a – Facade measurement</li> <li>• NC16 - Facade measurement</li> <li>• NC17- Facade measurement</li> <li>• NC18- Facade measurement</li> <li>• NC19 - Facade measurement</li> </ul>

Remarks:

<sup>(1)</sup> – Conduct noise monitoring only when construction work is carried out.

Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
Ground Borne Noise	L <sub>eq</sub> , L <sub>90</sub> & L <sub>10</sub> at 30 minute intervals during (0700 to 1900 on normal weekdays)	Once per week	<ul style="list-style-type: none"> <li>• GNC8 (Raimondi College)</li> </ul>	<ul style="list-style-type: none"> <li>• Ground floor inside the nearest building during the TBM construction work</li> </ul>

Remarks:

<sup>(1)</sup> – Conduct noise monitoring only when TBM construction work is carried out.

Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
Water Quality	<ul style="list-style-type: none"> <li>• Temperature (oC)</li> <li>• pH (pH unit)</li> <li>• Turbidity (NTU)</li> <li>• Water depth (m)</li> <li>• Salinity (mg/L)</li> <li>• Dissolved oxygen (DO) (mg/L and % of saturation)</li> <li>• Suspended solids (SS) (mg/L)</li> </ul>	Three times per week	<ul style="list-style-type: none"> <li>• CE (830026E, 814956N)</li> <li>• CF (831778E, 812420N)</li> <li>• I1 (831088E, 813654N)</li> <li>• I2 (831105E, 813582N)</li> <li>• Intake A (831603E, 813044N)</li> <li>• Intake B (830606E, 814583N)</li> </ul>	<ul style="list-style-type: none"> <li>• 3 water depths except CF, omit mid-depth sampling.</li> </ul>

---

---

**APPENDIX C  
ACTION AND LIMIT LEVELS FOR AIR  
QUALITY, NOISE AND WAER QUALITY**

---

---

## Appendix C - Action and Limit Levels

**Table C-1 Action and Limit Levels for 1-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AQ1	345	500
AQ2	321	

**Table C-2 Action and Limit Levels for 24-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AQ1	201	260
AQ3	156	

**Table C-3 Action and Limit Levels for Construction Noise**

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75* dB(A)
0700-2300 hrs on holidays; and 1900-2300 hrs on all other days		60/65/70** dB(A)
2300-0700 hrs of next day		45/50/55** dB(A)

(\*) reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods.

(\*\*) to be selected based on Area Sensitivity Rating.

**Table C-4 Action and Limit Levels for Water Quality**

Parameter		Action	Limit
DO, mg/L	Surface and Middle	6.3	6.2
	Bottom	6.0	5.8
SS, mg/L		15.7 or 120% of upstream control station's SS at the same tide of the same day	16.4 or 130% of SS readings at the upstream control station at the same tide of same day and specific sensitive receiver water quality requirements
Turbidity, NTU		10.2 or 120% of upstream control station's turbidity at the same tide of the same day	11.1 or 130% of turbidity at the upstream control station at the same tide of same day

---



---

**APPENDIX D  
GRAPHICAL PRESENTATION OF AIR  
QUALITY MONITORING RESULTS**

---

---



### 1-hr TSP Concentration Levels

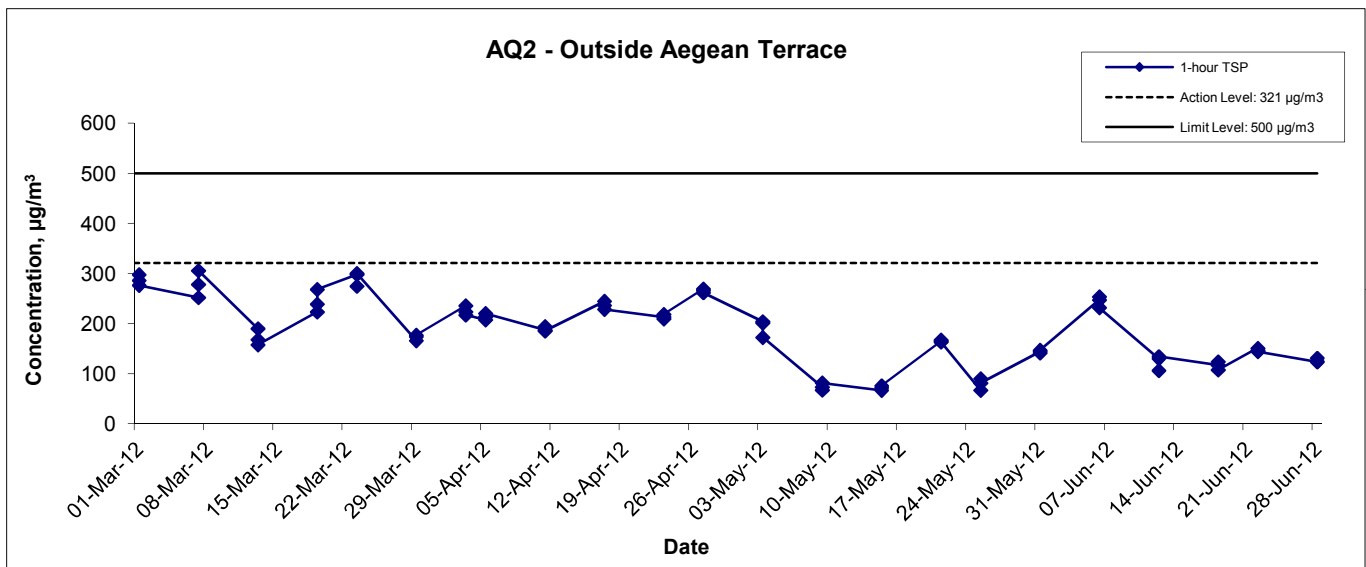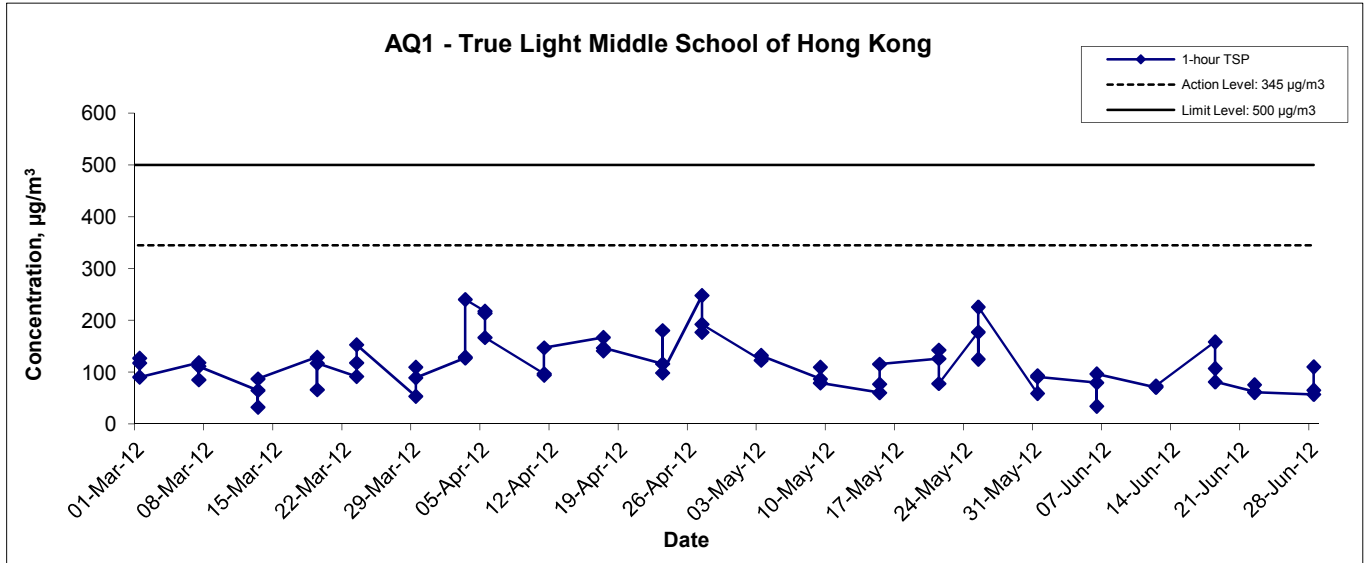

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of 1-hour TSP Monitoring Results	Scale N.T.S	Project No. MA8001	
	Date Jun 12	Appendix D	



## 24-hr TSP Concentration Levels

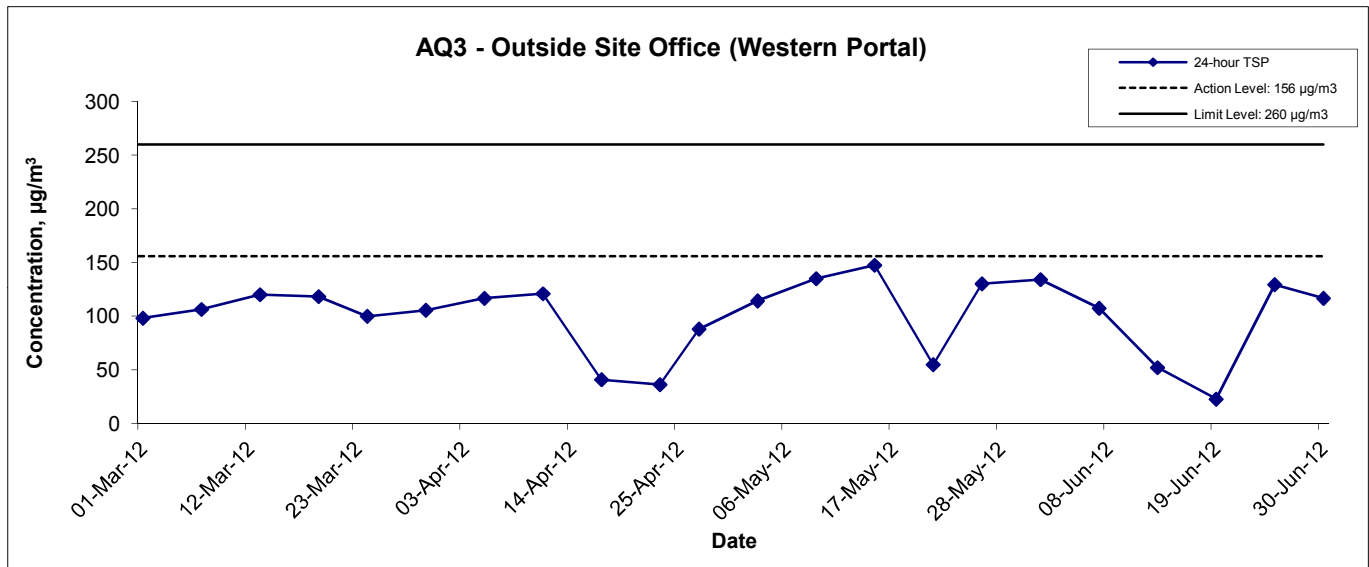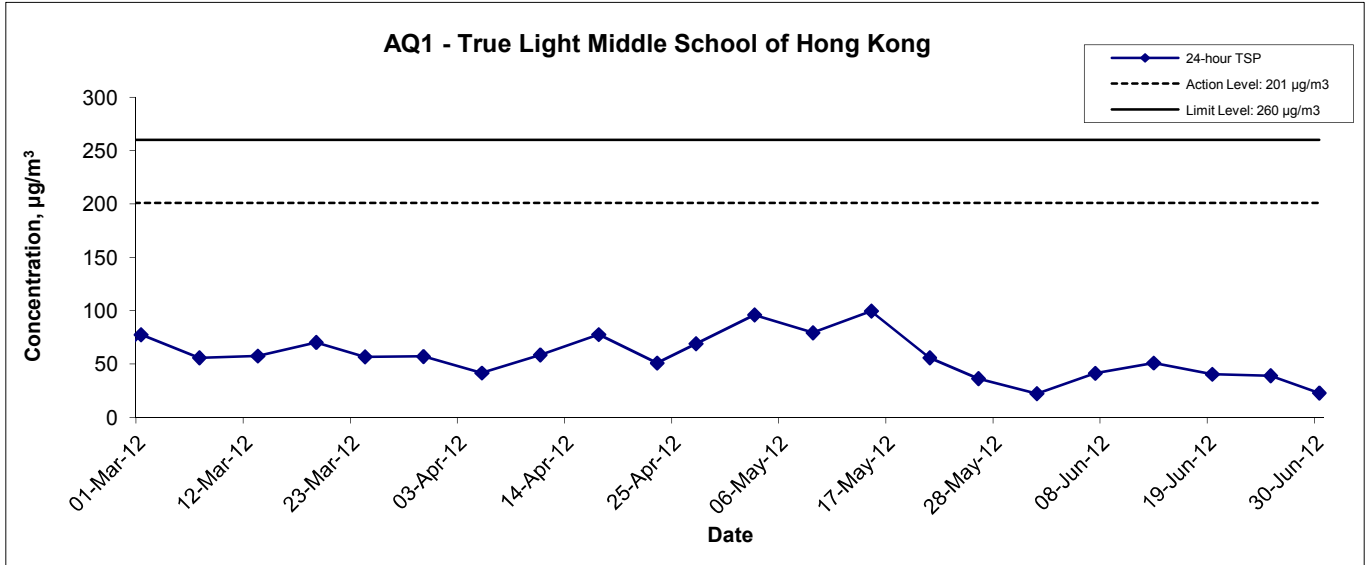

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of 24-hour TSP Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix D	

---




---

**APPENDIX E  
GRAPHICAL PRESENTATION OF  
NOISE MONITORING RESULTS**

---

---




## Noise Levels

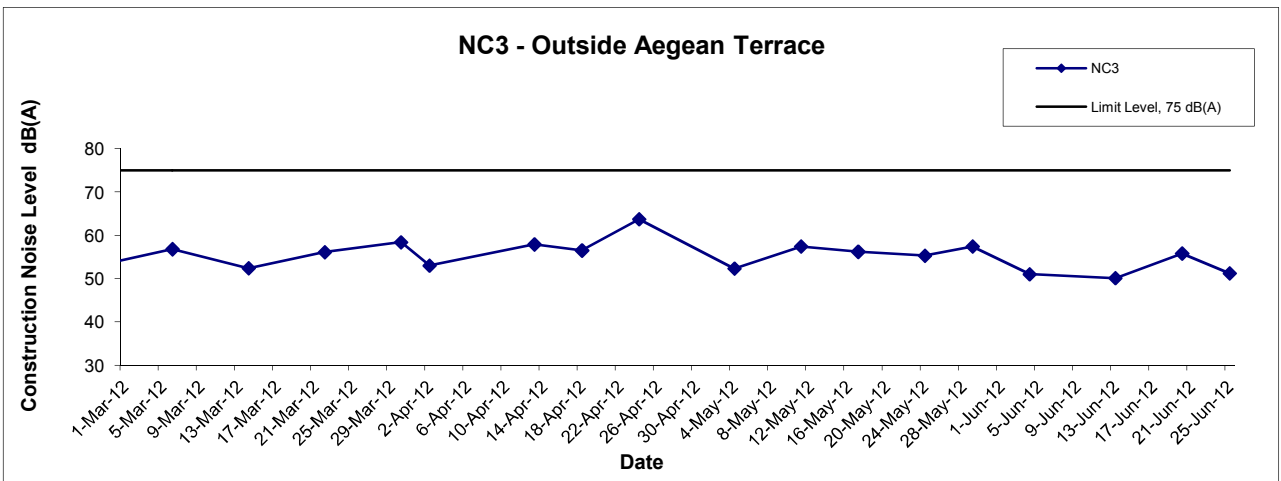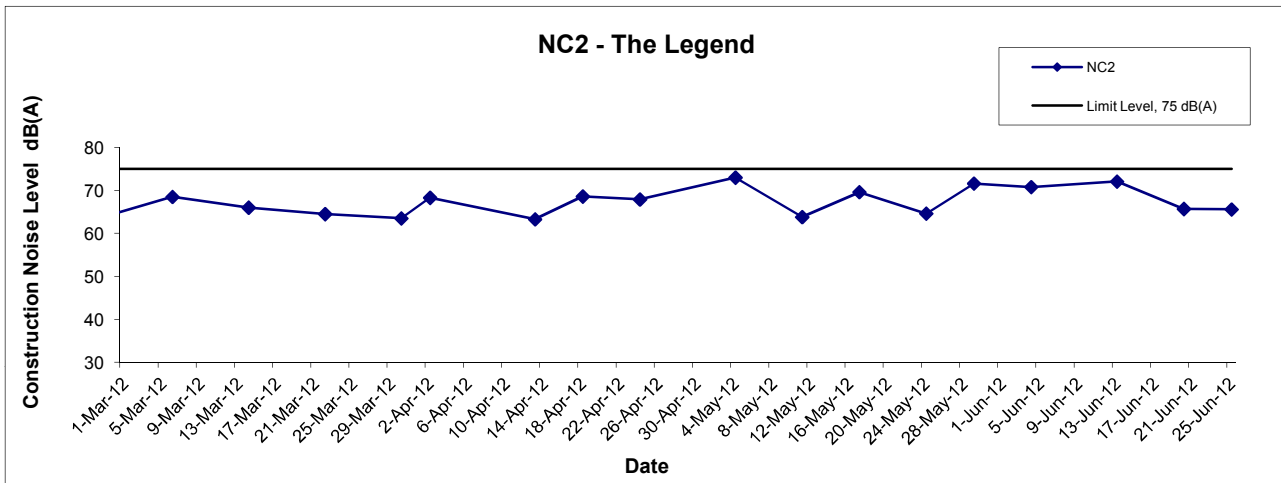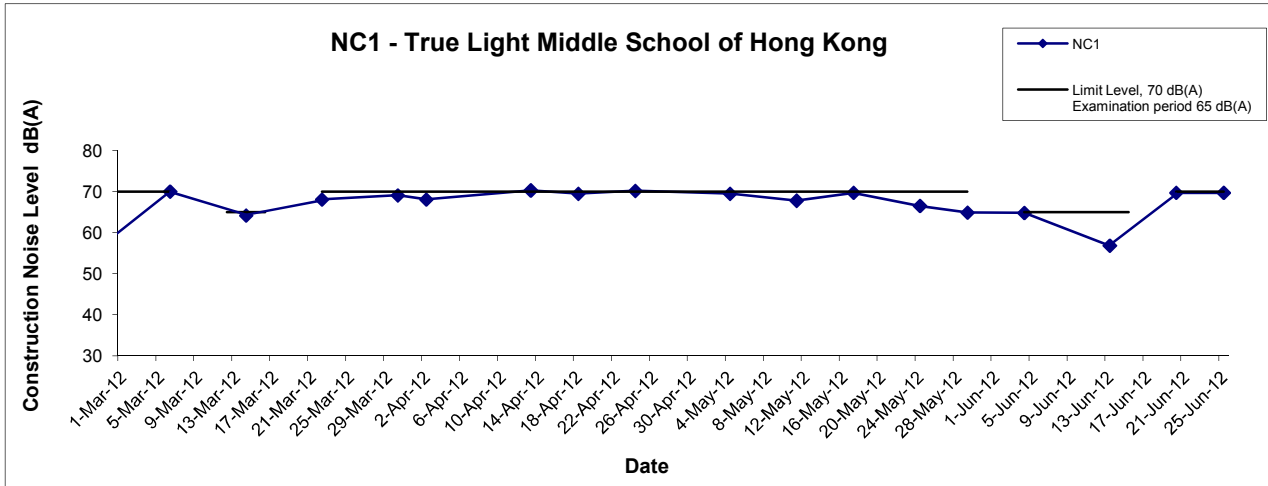

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA8001
	Date	Jun 12	Appendix	E




CINOTECH

## Noise Levels

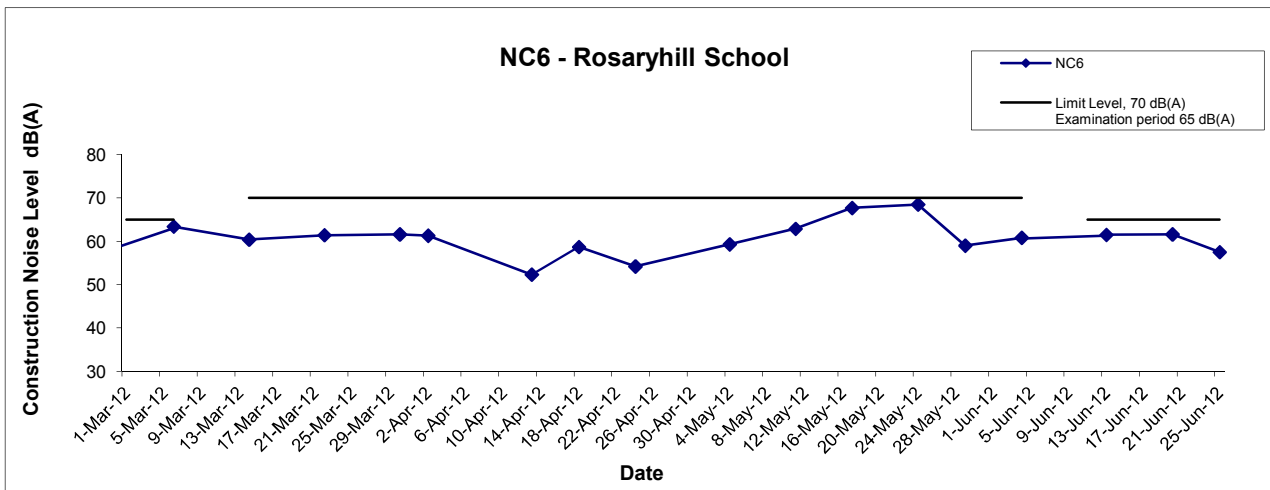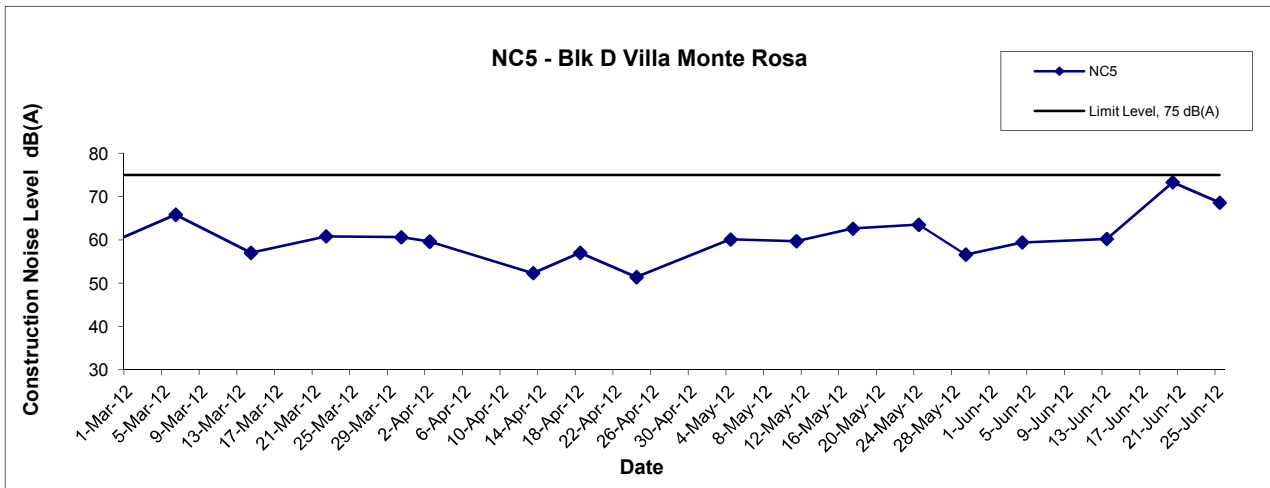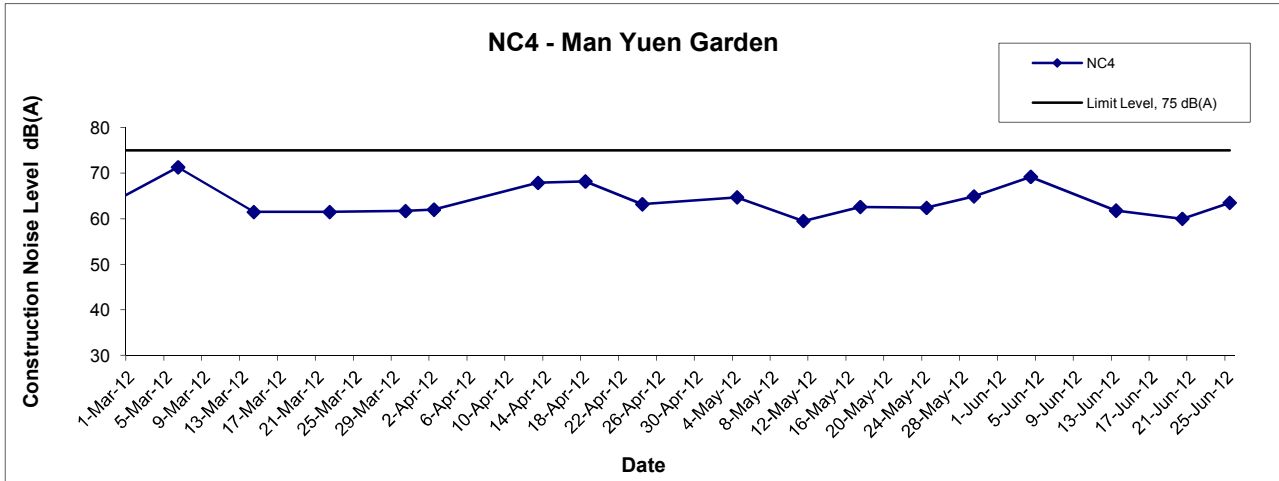




Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA8001	CINOTECH
	Date	Jun 12	Appendix	E	

## Noise Levels

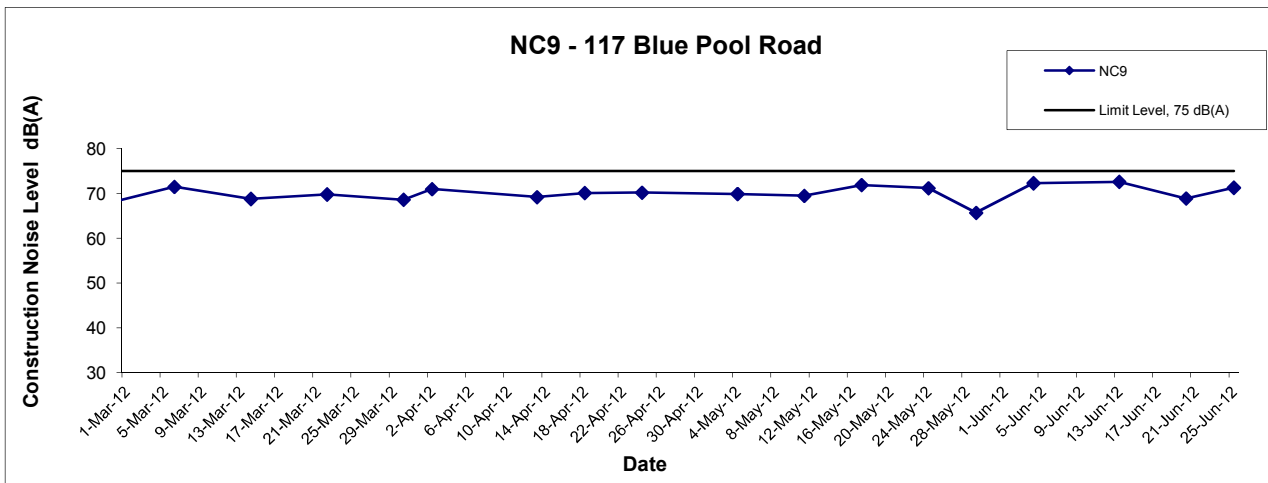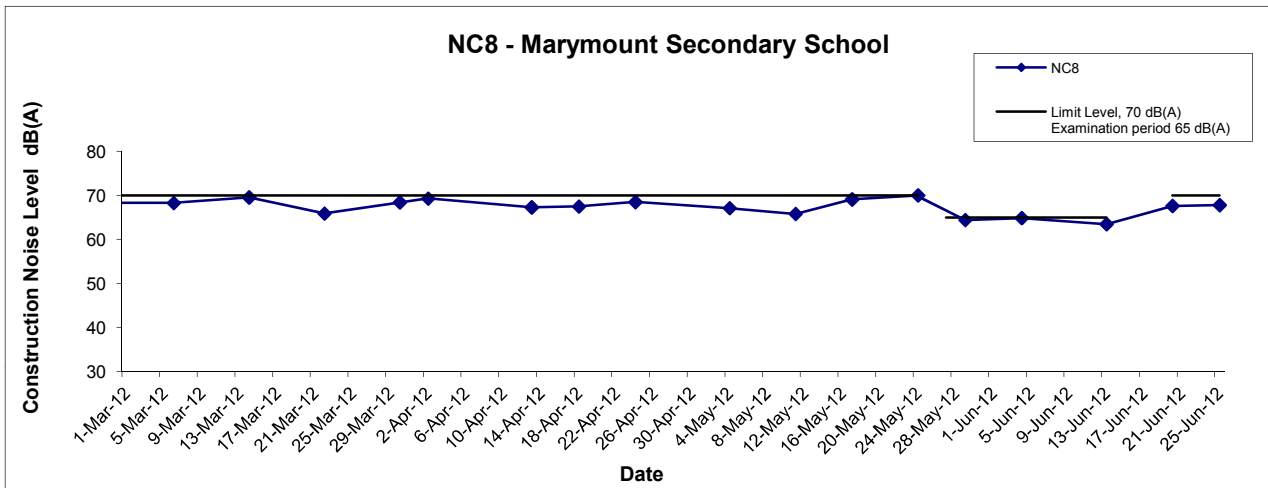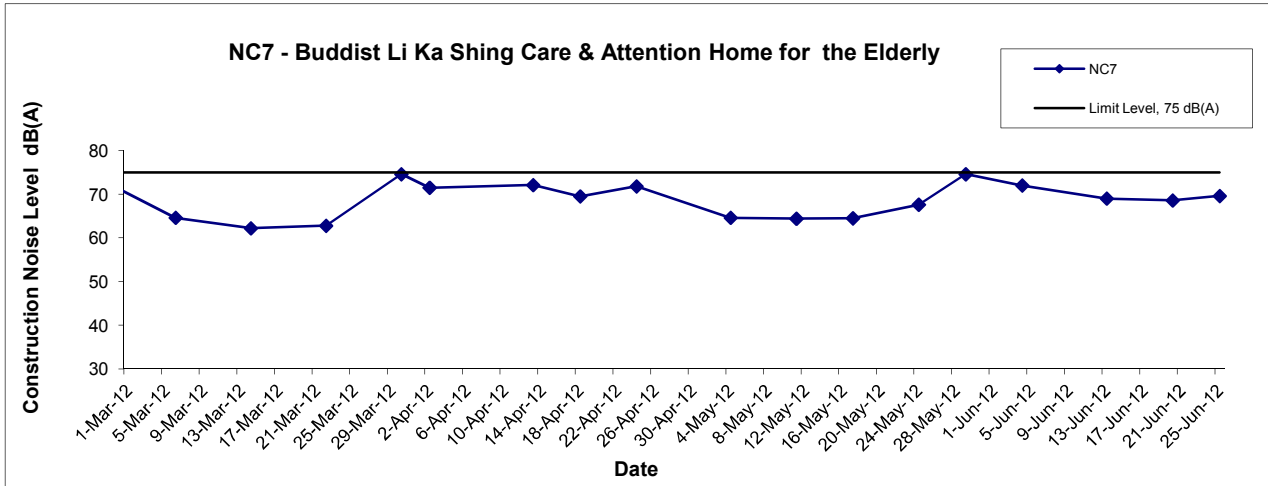




Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	Project No.	CINOTECH
	Date	Appendix	
	N.T.S	MA8001	
	Jun 12	E	

## Noise Levels

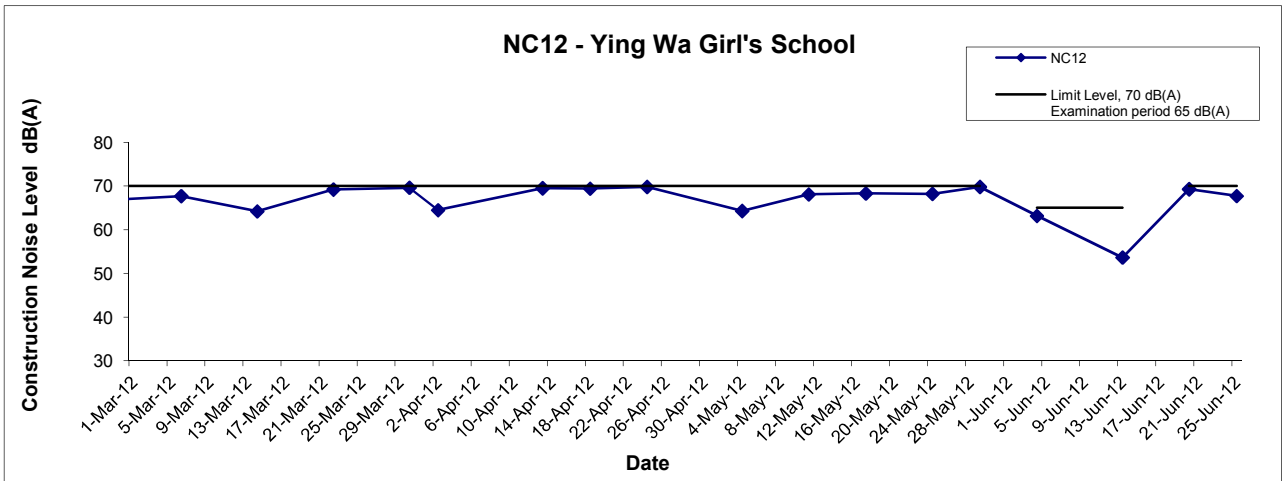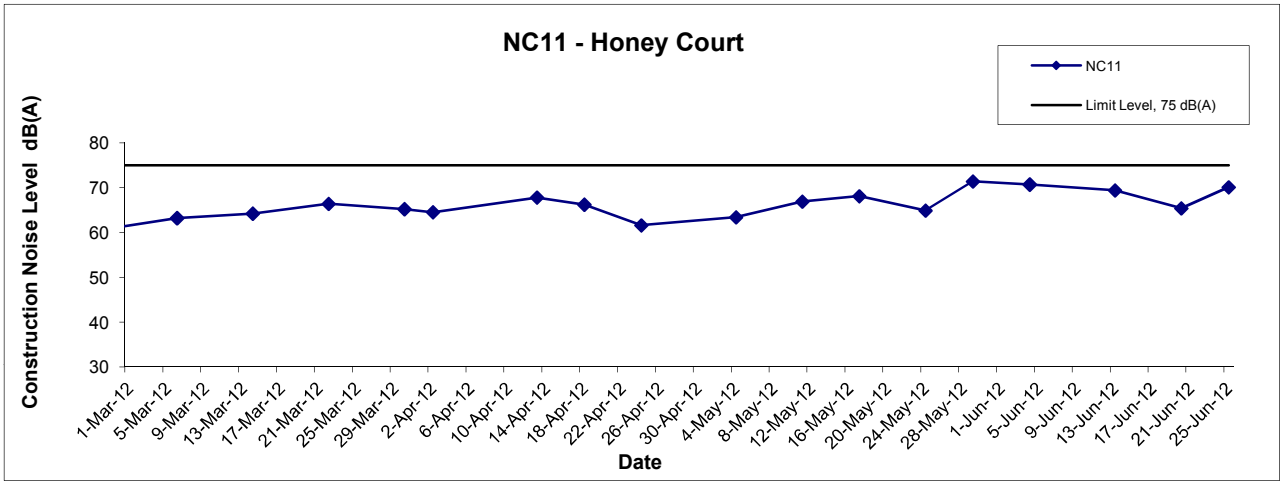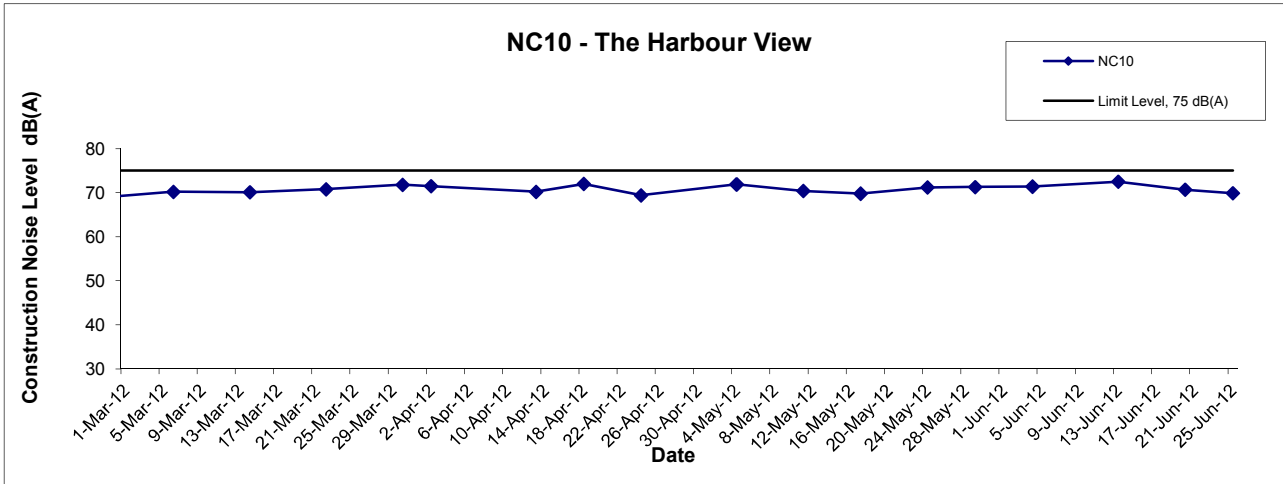




Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA8001	CINOTECH
	Date	Jun 12	Appendix	E	

## Noise Levels

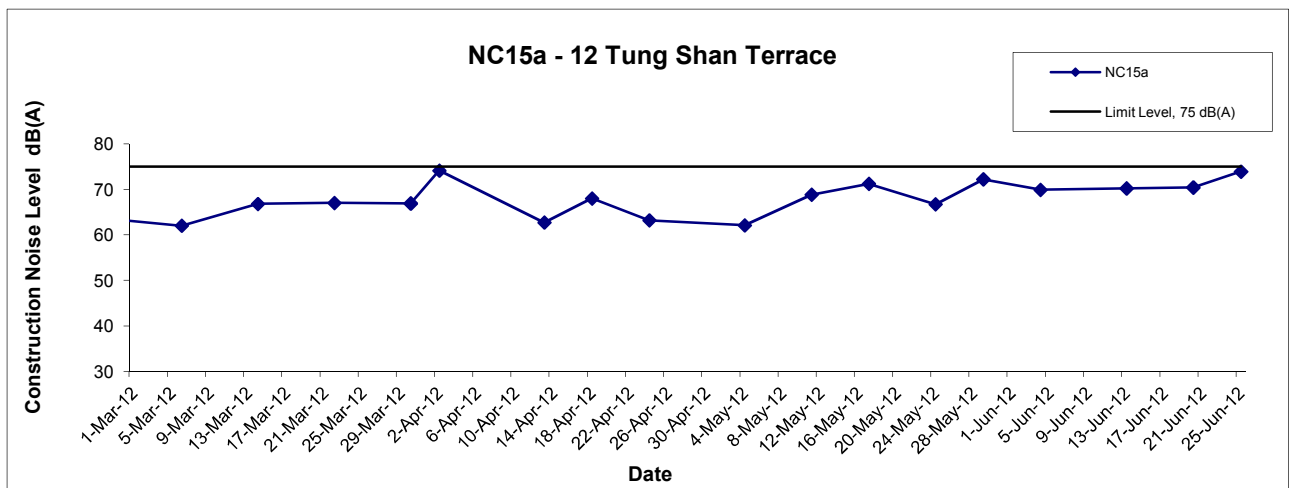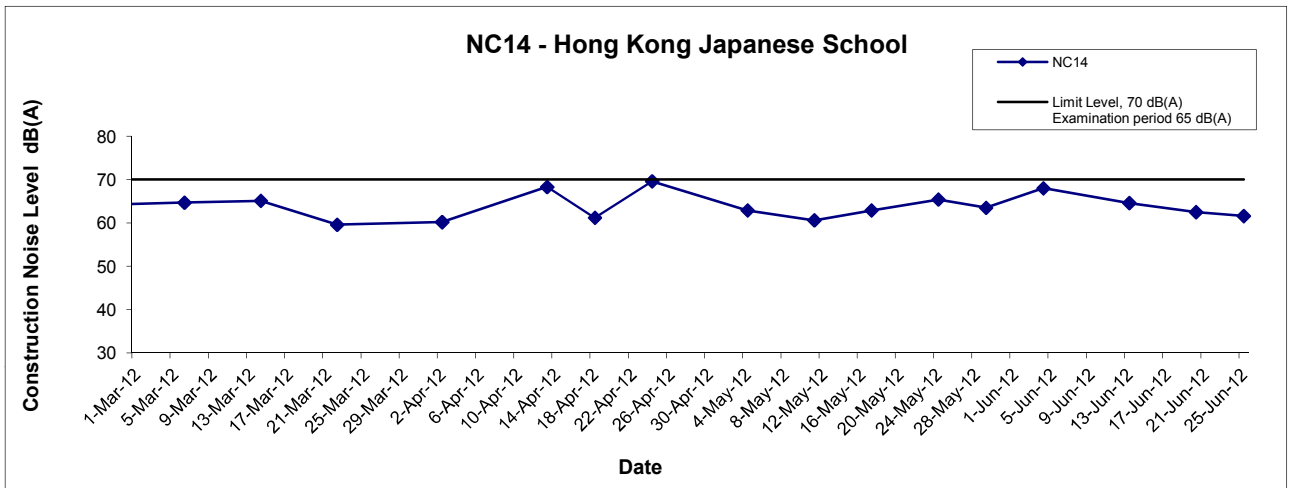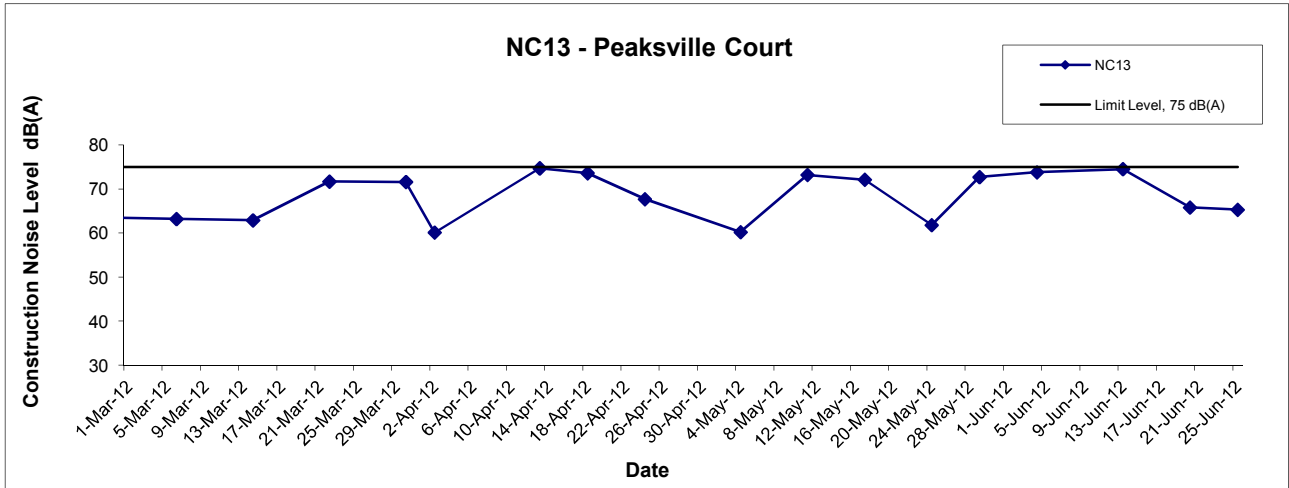

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA8001	CINOTECH
	Date	Jun 12	Appendix	E	



## Noise Levels

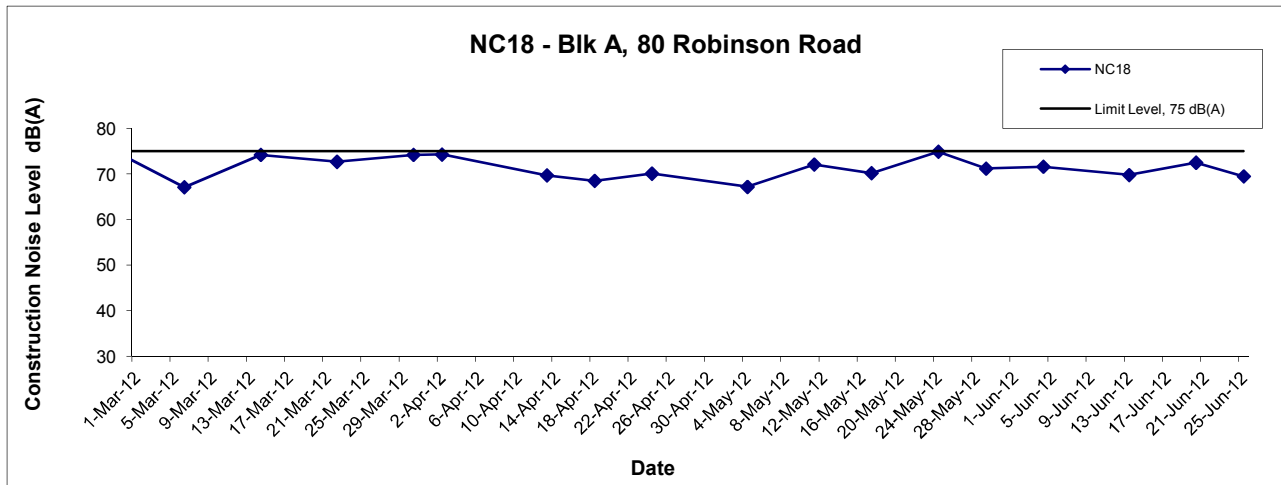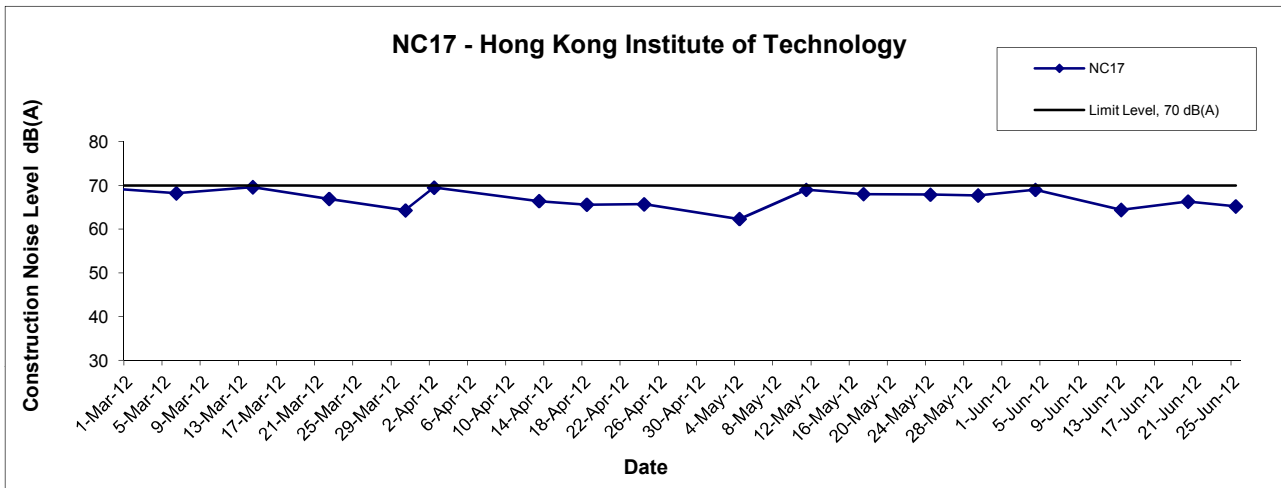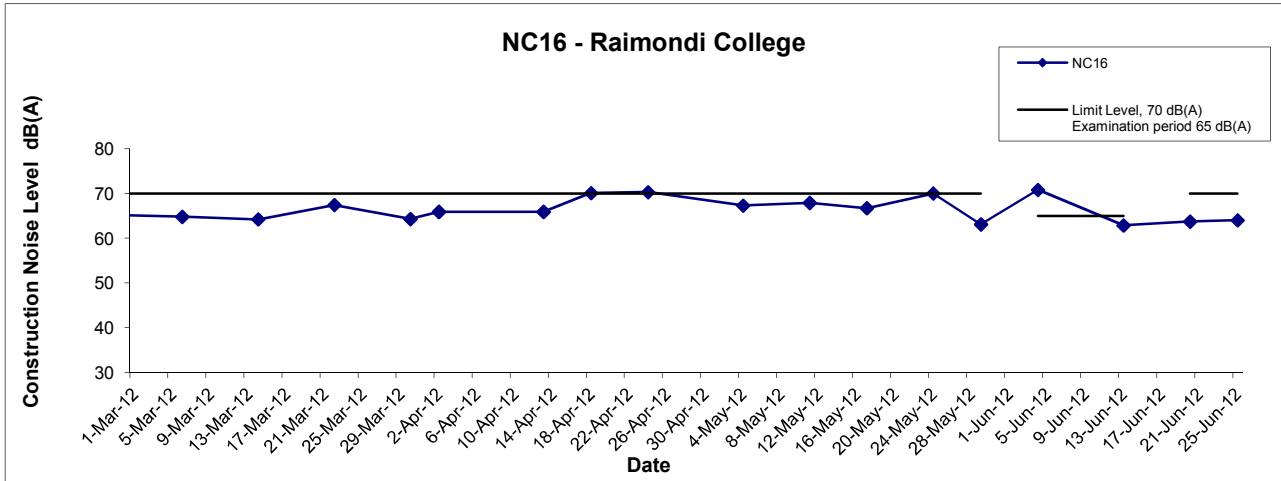

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA8001	CINOTECH
	Date	Jun 12	Appendix	E	



## Noise Levels

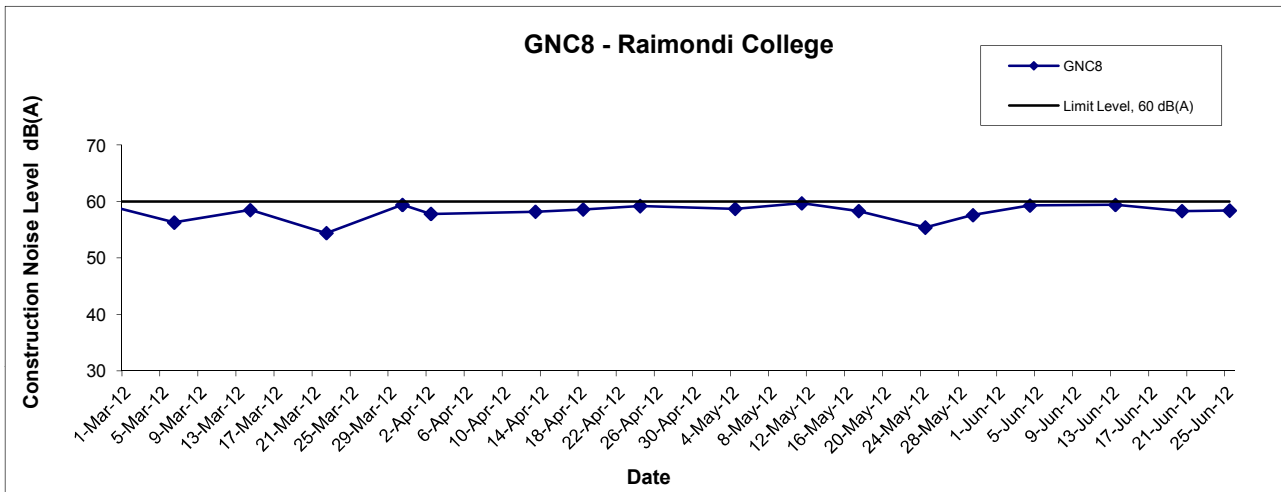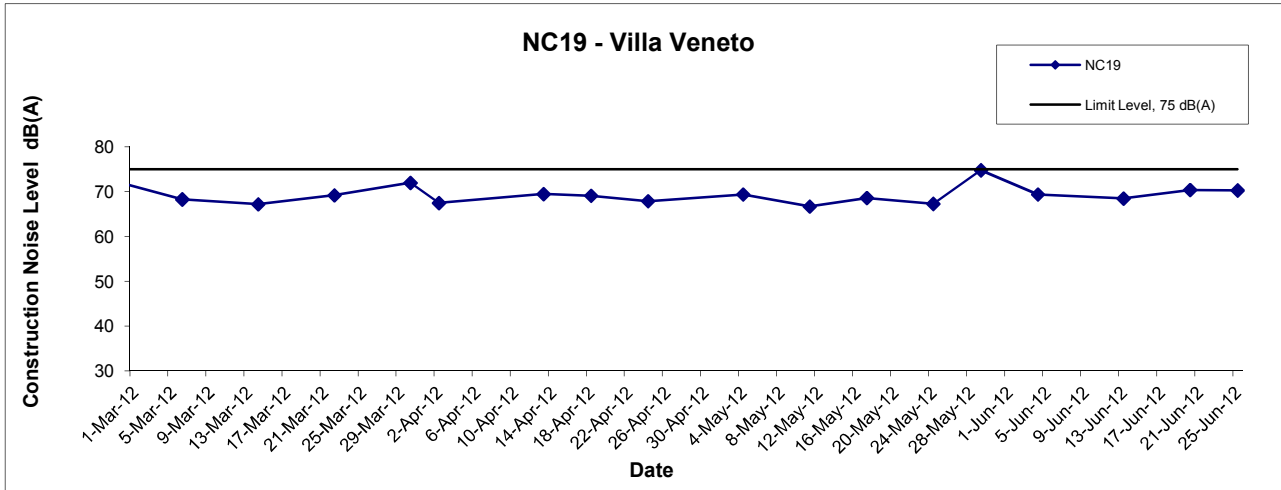

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results	Scale	N.T.S	Project No.	MA8001	CINOTECH
	Date	Jun 12	Appendix	E	

**APPENDIX F**  
**ENVIRONMENTAL MITIGATION**  
**IMPLEMENTATION SCHEDULE (EMIS)**

## Appendix F - Summary of Environmental Mitigation Implementation Schedule

Types of Impacts	Mitigation Measures	Status
<b>Construction Dust</b>	<i>Dust Mitigation Measures</i>	
	<ul style="list-style-type: none"> <li>The Contractor shall undertake at all times to prevent dust nuisance as a result of his activities. Effective dust suppression measures should be installed to minimize air quality impacts, at the boundary of the site and at any sensitive receivers.</li> </ul>	^
	<ul style="list-style-type: none"> <li>No blasting shall be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted (unless prior permission of the Commissioner of Mines is obtained).</li> </ul>	^
	<ul style="list-style-type: none"> <li>Effective water sprays shall be used during the delivery and handling of all raw sand, aggregate and other similar materials, when dust is likely to be created, to dampen all stored materials during dry and windy weather. Watering of exposed surfaces shall be conducted as often as possible depending on the circumstances.</li> </ul>	^
	<ul style="list-style-type: none"> <li>A watering programme of once every 2 hours in normal weather conditions, and hourly in dry/windy conditions.</li> </ul>	^
	<ul style="list-style-type: none"> <li>Any stockpile of dusty material cannot be immediately transported out of the Site shall be either: a) covered entirely by impervious sheeting; b) placed in an area sheltered on the top and the three sides; or c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet.</li> </ul>	*
	<ul style="list-style-type: none"> <li>Should a conveyor system be used, the Contractor shall implement the following precautionary measures. Conveyor belts shall be fitted within windboards. Conveyor transfer points and hopper discharge areas shall be enclosed to minimize dust emission. All conveyors under control of the Contractor, and carrying materials which have the potential to create dust, shall be totally enclosed and fitted with belt cleaners.</li> </ul>	^
	<ul style="list-style-type: none"> <li>Any dusty materials being discharged to vehicle from a conveying system at fixed transfer point, three-sided roofed enclosed with a flexible curtain across the entry shall be provided. Exhaust fans shall be provided for this enclosure and vented via a suitable fabric filter system.</li> </ul>	^
	<ul style="list-style-type: none"> <li>The heights from excavated spoils are dropped should be minimise to reduce the fugitive dust arising from unloading/loading.</li> </ul>	^
	<ul style="list-style-type: none"> <li>The Contractor shall confine haulage and delivery vehicles to designated roadways inside the site. If in the opinion of the Engineer, any motorising vehicle is causing dust nuisance, the Engineer may require that the vehicle be restricted to a maximum speed of 15km per hour while within the site area.</li> </ul>	^
	<ul style="list-style-type: none"> <li>Areas within the site where there is a regular movement of vehicles shall have an approved hard surface, be kept clear of loose surface materials and / or be regularly watered.</li> </ul>	^
	<ul style="list-style-type: none"> <li>Wheel cleaning facilities shall be installed for both portals and used by all vehicles leaving the site. No earth, mud, debris, dust and the like shall be deposited on public roads. Water in the wheel cleaning facility shall be changed at frequent intervals and sediments shall be removed regularly. The Contractor shall submit details of proposals for the wheel cleaning facilities to the Engineer prior to construction of the facility. Such wheel cleaning facilities shall be usable prior to any earthwork excavation activity on site. The Contractor shall provide a hard-surfaced road between any cleaning facility and the public road.</li> </ul>	^
	<ul style="list-style-type: none"> <li>Chemical wetting agents shall only be used on completed cuts and fills to reduce wind erosion.</li> </ul>	N/A

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
 N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
 \* Recommendation was made during site audit but improved/rectified by the contractor;  
 # Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<ul style="list-style-type: none"> <li>• No vehicle exhausts shall be directed towards the ground or downwards to minimize dust nuisance.</li> <li>• Ventilation system, equipped with proprietary filters, should be provided to ensure the safe working environment inside the tunnel. Particular attention should be paid to the location and direction of the ventilation exhausts. The exhausts should not be allowed to face any sensitive receivers directly. Consideration should also be given to the location of windows, doors and direction of prevailing winds in relation to the nearby sensitive receivers.</li> <li>• In the event of any spoil or debris from construction works being deposited on adjacent land, or stream, or any silt being washed down to any area, then all such spoil, debris or material and silt shall be immediately removed and the affected land and areas restored to their natural state by the Contractor to the satisfaction of the Engineers.</li> </ul> <p>In addition, based on the <i>Air Pollution Control (Construction Dust) Regulation</i>, any works involved regulatory and notifiable works, such as stockpiling, loading and unloading of dusty materials, shall take precautions to suppress dust nuisance.</p> <ul style="list-style-type: none"> <li>• The working area of any excavation or earthmoving operation shall spray with water or a dust suppression chemical immediately before, during and immediately after the operation so as to maintain the entire surface wet;</li> <li>• Exposed earth shall be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies; and</li> <li>• Any stockpile of dusty materials (greater than 20m<sup>3</sup>) shall be either covered entirely by impervious sheeting or placed in an area sheltered on the top and three sides; and sprayed with water or a dust suppression chemical so as to maintain the entire surface wet.</li> <li>• Other suitable dust control measures as stipulated in <i>Air Pollution Control (Construction Dust) Regulation</i>, where appropriate, should be adopted.</li> </ul>	<p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
<b>Construction Noise</b>	<p><u>Air borne noise</u></p> <p>In general, potential construction noise impact can be minimized or avoided by imposing a combination of the following mitigation measures:</p> <ul style="list-style-type: none"> <li>• Noisy equipment and activities should be sited by the Contractor as far from close-proximity sensitive receivers as practical. Prolonged operation of noisy equipment close to dwellings should be avoided.</li> <li>• The Contractor should minimise construction noise exposure to the schools (especially during examination periods). The Contractor should liaise with the school and the Examination Authority to ascertain the exact dates and times of all examination periods during the course of the works contract and to avoid noisy activities during these periods.</li> <li>• Noisy plant or processes should be replaced by quieter alternatives. Silenced diesel and gasoline generators and power units, as well as silenced and super-silenced air compressor, can be readily obtained.</li> <li>• Noisy activities should be scheduled to minimise exposure of nearby sensitive receivers to high levels of construction noise. For example, noisy activities can be scheduled for midday, or at times coinciding with periods of high background noise (such as during peak traffic hours).</li> <li>• Idle equipment should be turned off or throttled down. Noisy equipment should be properly maintained and used no more often than is necessary.</li> <li>• The power units of non-electric stationary plant and earth-moving plant should be quietened by vibration isolation and partial or full acoustic enclosures for individual noise-generating components.</li> <li>• Construction activities should be planned so that parallel operation of several sets of equipment close to a given receiver is avoided, thus reducing the cumulative impacts between operations. The numbers of operating items of powered mechanical equipment should be minimised. Noise can be reduced by increasing the distance between the operating equipment and the NSRs or by reducing the number of items of equipment and/or construction activity in the area at any one time.</li> <li>• The use of quiet plant working methods can further reduce noise level. Quiet plant is defined as Powered Mechanical Equipment (PME) whose actual sound power level is less than the value specified in the TMs for the same piece of equipment. To allow the Contractor some flexibility to select equipment to suit his needs, it is considered too restrictive to specify which specific items of silenced equipment to be used for the construction operations. It should be noted that various types of silenced equipment can be found in Hong Kong and are readily available on the market. BS 5228 also provides examples of quiet construction plant and their SWL.</li> <li>• Construction plant should be properly maintained (well-greased, damage and worn parts promptly replaced) and operated. Construction equipment often has silencing measures built in or added on, e.g. bulldozer silencers, compressor panels, and mufflers. Silencing measures should be properly maintained and utilised. Rubber or damping materials should be introduced between metal panels to avoid rattle and reverberation of noise.</li> <li>• Equipment known to emit sound strongly in one direction should be oriented so that the noise is directed away from nearby NSRs.</li> <li>• Materials stockpile and other structures (such as site offices) should be effectively utilised to shield construction noise. Noise</li> </ul>	<p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<p>can also be reduced by construction of temporary noise barriers which screen the lower floors from viewing the sites. Temporary noise barriers should be installed at active parts of construction areas where construction equipment is being operated in close proximity to NSRs.</p> <ul style="list-style-type: none"> <li>• It is noted that under the WBTC No. 19/2001, all construction sites are required to use metallic site hoarding can be slightly modified (with the addition of steel backings) into temporary noise barriers. These barriers should be gap free and have a surface mass density of at least 7kg/m<sup>2</sup>.</li> <li>• All hand-held percussive breakers and air compressors should comply the Noise Control (Hand-held Percussive Breakers) Regulations respectively under the NCO (Ordinance No. 75/88, NCO Amendment 1992 No.6).</li> </ul> <p>The Contractor shall devise, arrange methods of working and carry out the works in such manner as to minimise noise impacts on the surrounding environment, and shall provide experienced personnel with suitable training to ensure that these measures are implemented properly.</p> <p><u>Level 2 Use of Barriers</u></p> <p>Level 2 mitigation measures include providing movable barriers for sites which have sufficient space for installation, full enclosures during the drilling activities at Eastern Portal and at muck pit areas for Eastern portals and cantilever-typed high rise noise barrier for intake W5 (P) and W8.</p> <p>Before construction of the full enclosure at muck pit area, the use of full enclosure noise barrier (Stage A) for the drilling activities at the Eastern Portal area is required. A full enclosure for the muck pit area will then be constructed at this later stage (Stage B). The full enclosure shall be gap free apart from necessary entrance/exits, which shall face towards the entrance of eastern portal to minimize the amount of noise generated from affecting the nearest RNSRs especially school (True Light Middle School of Hong Kong).</p> <p>5m high cantilever-typed hoarding barrier to be built at W5 (P) and W8. These enclosures/barriers should have no gaps and have a superficial surface density of at least 10kg/m<sup>2</sup>. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period. To schedule the noise barrier erection and dismantling to the non sensitive periods of school to avoid adverse impact to W8/3.</p> <p>Movable barriers of 3 to 5m height with a small cantilevered upper portion and skid footing to be located within about 5 m or more for mobile equipment such that the line of sight is blocked. To provide purposes-built noise barriers or screens constructed of appropriate materials (minimum superficial density of 10kg/m<sup>2</sup>) located close to the operating PME.</p> <p>Pre-drilling following by chemical splitting instead of using large excavator mounted breaker should be used as mitigation measure for rock breaking and rock drilling.</p>	<p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<p>No construction activity is recommended during the examination period.</p> <p><u>Ground borne noise</u></p> <p>The noise level should be measured on the ground floor inside the nearest building during the TBM construction work in the daytime. If the daytime monitored ground borne noise exceeds the relevant evening/night ground borne noise criteria, evening/night construction work would not be carried out for the concerned tunnel section. Evening/night time construction work is subject to CNP application under the control of NCO.</p> <p>Public relationship strategy with 24-hour hotline system.</p>	<p>^</p> <p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Water Quality	<u>Precautionary measures for construction work near natural streams</u>	
	<p>The government provides guidelines (ETWB TCW NO. 5/2005 and DSD TC 2/2004) are providing guidelines to minimize impacts when there is construction work carried out at near natural streams course. Relevant mitigation measures for the intakes are summarised as follows:</p>	
	<ul style="list-style-type: none"> <li>• Temporary site access to the work sites should be carefully planned and located to minimize disturbance caused to the substrates of streams/rivers and riparian vegetation by construction plant.</li> </ul>	^
	<ul style="list-style-type: none"> <li>• Locations well away from the rivers/streams for temporary storage of materials (e.g equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil should be identified before commencement of works.</li> </ul>	^
	<ul style="list-style-type: none"> <li>• Proposed works site areas inside, or in the proximity of, natural rivers and streams should be temporarily isolated to prevent adverse impacts on the stream water qualities.</li> </ul>	^
	<ul style="list-style-type: none"> <li>• Stockpiling of construction materials, if necessary, should be completely properly covered and located away from any natural stream/river.</li> <li>• Construction debris and spoil should be covered up and/or properly disposed of as soon as possible to avoid being washed into nearby rivers/streams by rain and local runoff.</li> </ul>	^ *
<u>Construction of temporary berthing point at the Western Portal</u>		
<p>A refuse collection vessel shall be provided to collect refuse or materials lost into the sea.</p>	^	
<p>The respective areas of the marine works will be completely enclosed by the silt curtain. The curtain shall be extended from water surface down to the seabed where it is anchored using sinker blocks. The Contractor shall inspect the silt curtain on regular basis to ensure its integrity and it is serviceable for all times.</p>	N/A	

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.



Types of Impacts	Mitigation Measures	Status
	<p>Transfer of armour rock onto the seabed from barge at the temporary pier location should be conducted by careful grabbing and unloading to the seabed (to minimize sediment migration).</p>	^
	<p>The conveyor belt should be completely covered and muddy effluent from the temporary barge should be contained, treated and disposed. Where there is transfer of excavated wastes, the Contractor should provide appropriate measures to ensure that the waste is free from floatables, putrescibles, organic wastes and toxic materials and when required a refuse collection vessel be provided to collect float refuse.</p>	^
	<p><u>Construction of stilling basin at Western Portal outfall</u></p>	
	<p>All construction for the basin should be carried out inside the temporary cofferdam which is a temporary watertight enclosure built in the water and pumped dry to expose the bottom so that construction of stilling basin can be undertaken.</p>	^
	<p>During the dewatering process, appropriate desilting/sedimentation devices should be provided on site for treatment before discharge. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge.</p>	^
	<p>The cofferdam will remain on site until after the construction of stilling basin has been completed. The coffer dam shall be regularly inspected and maintained to ensure no spillage of waste or wastewater into the sea. Conveyance of dredged materials from the coffer dam shall be carried out cautiously to avoid spillage into the sea.</p>	^
	<p>The filled material for the stilling basin should be contained inside the temporary cofferdam. The top level of the cofferdam shall be constructed higher than the final backfilled level.</p>	^
	<p>The Contractor shall be responsible for the design, installation and maintenance of the silt curtains to minimize the impacts on the water quality and the protection of water quality. The design and specification of the silt curtains shall be submitted by the Contractor to the Engineer for approval.</p>	N/A
	<p>Silt curtains shall be formed from tough, abrasion resistant, permeable membranes, suitable for the purpose, supported on floating booms in such a way as to ensure that the sediment plume shall be restricted to within the limit of the works area. The silt curtain shall be formed and installed in such a way that tidal rise and fall are accommodated, with the silt curtains always extending from the surface to the bottom of the water column and held with anchor blocks. The removal and reinstallation of such curtains during typhoon conditions shall be as agreed with the Director of Marine Department. The contractor shall regularly inspect the silt curtains and check that they are moored and marked to avoid danger to marine traffic. Any damage to the silt curtain shall be repaired by the Contractor promptly and the works shall be stopped until the repair is fixed to the satisfaction of the Engineer.</p>	N/A

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<p>Transfer of rock fill material (armour rock) from the barge onto the site location should be conducted by grabbing and placement on the seabed to minimize sediment migration. No free dropping of the material will be allowed.</p> <p>Prior to the construction of armor rock based panel, a silt curtain shall also be installed prior to carry out any marine works as a preventive mitigation measure.</p> <p><u>Construction of TBM tunnel at both portals and intakes</u></p> <p>Recycled water will be used at the cutter face for cooling purposes. Used water will be collected and discharged to a settling tank for settlement. Excess water from the settling tank will be transferred to the water treatment plant on site where the addition of flocculants will assist in settlement of solids. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge.</p> <p>During the drilling process, all flushing water will be recycled for use. Discharge of the treated water to nearby drainage system shall be allowed provided that it has been treated to a level meeting with statutory requirements.</p> <p>Water flow at streams should be maintained by a temporary diversion system during the construction phase of intakes and manhole drop shafts.</p> <p><u>General Construction Activities and Workforce</u></p> <p>A. Surface runoff</p> <p>Effluent produced from construction activities are subjected to WPCO control. Effluent produced from sites should be diverted away from stream courses. Construction works near stream course should be scheduled in the dry season as far as practical to avoid excessive site runoff discharge.</p> <p>Under the <i>Water Pollution Control Ordinance</i> (WPCO), turbid water from construction sites must be treated to minimize the solids content before being discharged into storm drains. The suspended solids load can be reduced by directing the runoff into temporary sand traps or other silt-removal facilities, and other good and appropriate site management practices. Advice on the handling and disposal of construction site discharge is provided in the ProPECC Paper (PN 1/94) on Construction Site Drainage.</p> <p>A drainage system layout should be prepared by the Contractor for each of the works areas (portals and intakes), detailing the facilities and measures to manage pollution arising from surface runoff from those works areas. The drainage layout and an associated drainage management plan to reduce surface runoff sediments and pollutants entering watercourses, should be submitted to the Engineer for approval and to EPD for agreement.</p>	<p>^</p> <p>N/A</p> <p>^</p> <p>^</p> <p>^</p> <p>*</p> <p>*</p> <p>*</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<p>The system should be capable of handling stormwater from the site and directing it to sediment removal facilities before discharge. If oil and grease is used on the site or brought to the site, the stormwater should pass through oil interceptors before discharge. The interceptors should have a bypass to prevent washout in heavy storms.</p> <p>A temporary channel system or earth bunds or sand barriers should be provided in works areas on site to direct stormwater to silt-removal facilities. Stockpiled materials, if susceptible to erosion of rain or wind, should be covered with tarpaulins (or/similar fabric) or hydroseedings as far as practicable especially during the wet season.</p> <p>Silt removal facilities should be checked and the deposited silt and grit should be removed regularly to ensure these facilities are in good working condition and to prevent blockages.</p> <p>Vehicle washing areas should be drained into a settlement basin to settle out the suspended solid before discharge to storm water drains. The water should be recycled on site whenever possible. It is suggested that the wash water from the wheel wash basin is either reused for road watering or pumped to the on-site settling tanks for treatment. Water used for dust depression purposes should be minimized and an alternative soil holding agent should be considered.</p> <p><b>B. Spillage, Oil and Solvents</b>  Any contractor generating waste oil or other chemicals as a result of his activities should register as a chemical waste producer and provide a safe storage area for chemicals on site. Oil interceptors need to be regularly inspected and cleaned to avoid wash-out of oil during storm conditions. A bypass should be provided to avoid overload of the interceptor's capacity.</p> <p>Any spillage should be cleaned up immediately and the resulting contaminated absorbent material should be properly managed according to Waste Disposal Regulations. Spills should be contained to avoid spreading and contaminating the water resources.</p> <p>Oil and fuels should be used and stored properly in designated area. All fuel tanks and storage areas should be provided with locks and be sited on within sealed areas within surrounded by bunds of with a capacity equal to 110% of the storage capacity of the largest tank.</p> <p>Good housekeeping practices are required to minimize careless spillage and keep the work space in a tidy and clean condition. Appropriate training, including safety codes and relevant manuals, should be given to the personnel who regularly handle the chemicals on site.</p>	<p>^</p> <p>*</p> <p>*</p> <p>^</p> <p>^</p> <p>*</p> <p>*</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<p>C. On-Site Effluent Generation</p> <p>Sewage arising from the additional population of workers on site should be collected in a suitable storage facility (chemical mobile toilets). Most of the work site locations are close to the public sewerage system, and therefore the use of septic tanks isare, therefore, not encouraged. Portable toilets should be used coupled with tickering away services provided by a licensed collector. They should be positioned at appropriate locations across the site to ensure no direct discharge of foul water off-site.</p> <p>D. Protection of Existing Flora and Fauna</p> <p>The Contractor should provide details of the plant and operation plans at each site for approval by the Engineer before commencing construction. The plans should include how the existing flora and fauna will be protected. Locations required for groundwater levels monitoring are Eastern Portal, PFLR1(P), THR2(P), TP5, TP789 and W12.</p> <p>The construction and demolition of the temporary pier may create short term impacts on the local marine water quality. The situation will be restored once the work is finished by proper phasing of the works programme and implementation of the adequate mitigation measures (e.g. silt curtain) the impacts will be minimized.</p> <p><u>Maintaining Baseflow in Downstream Watercourses</u></p> <p>The final design will be developed during the detailed design stage. The exact base flow rates to be maintained at each of the intakes will be subject to detailed site investigation at design stage.</p> <ul style="list-style-type: none"> <li>• Purpose of the by-pass device is to maintain the base-flow of the affected stream course.</li> <li>• The by-pass system comprises an approach link and a trapezoidal channel.</li> <li>• The approach link is section with inclined profiled surface at a gradient of 1 in 100. It is used to direct the base flow to the bypass trapezoidal channel at its down stream end during the normal days.</li> <li>• The trapezoidal channel is sized such that it could handle the base flow in the affected stream course which is estimated to be no more than 20 l/s.</li> <li>• Whenever the flow in the stream course exceeding the base flow rate, the excessive flow will overflow into the intake structure via the bottom rack structure. The bottom rack structure has bar screen on the top and inclined channel at the bottom. The top level of the bar screen is level with the by-pass channel with an aim to receive the overflow from the by-pass channel.</li> <li>• The by-pass channel is designed requiring minimum maintenance. However, it is recommended that the maintenance authority carry out regular maintenance inspection prior to onset of seasons and after significant rainstorm event to prevent blockage of the by-pass and bottom rack structure.</li> </ul>	<p>^</p> <p>^</p> <p>^</p> <p></p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
 N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
 \* Recommendation was made during site audit but improved/rectified by the contractor;  
 # Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
<b>Waste/Chemical</b>	<p><u>General</u></p> <p>A proper waste management plan should be implemented to promote waste minimisation at source. Where waste generation is unavoidable then the potential for recycling or reuse should be explored and opportunities taken. If wastes cannot be recycled then the recommended disposal routes should be followed.</p>	*
	<p>All waste materials shall be segregated into categories covering:</p> <ul style="list-style-type: none"> <li>• Excavated material or construction waste suitable for reuse on-site</li> <li>• Excavated material or construction waste suitable for public filling areas</li> <li>• Remaining C&amp;D waste for landfill</li> <li>• Chemical waste, and</li> <li>• General refuse</li> </ul>	<p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p>
	<p>Proper segregation and disposal of construction waste should be implemented. Separate containers for inert and non-inert wastes should be provided. The inert waste should be taken to public filling area and the non-inert waste should be transported to strategic landfills.</p>	^
	<p>A trip-ticket system on the solid waste transfer/disposal operations should be included as one of the contractual requirements (ETWB TCW No. 31/2004). The Independent Environmental Checker (IEC) should be responsible for auditing this system.</p>	^
	<p>IEC should also be responsible for auditing the well-documented record system which includes: (i) quantity of waste generation, (ii) quantity of recycled material, (iii) quantity of disposed material, (iv) disposal methods and (v) sites should be implemented during construction phase.</p>	^
	<p>Regular cleaning and maintenance of the waste storage area should be conducted throughout the construction stage.</p>	^
	<p><u>Excavated spoil</u></p> <p>Control measures for soil temporarily stockpiled on-site should be taken in order to minimize the noise, generation of dust, pollution of water and visual impact. Key impacts include:</p>	^

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.



Types of Impacts	Mitigation Measures	Status
<b>Terrestrial Ecology</b>	<p>During the detailed design stage, the following issues should also be considered as possible to further minimise the impacts:</p> <ul style="list-style-type: none"> <li>• Adjustment of site boundary to minimise temporary loss of natural stream habitat during construction.</li> <li>• Adjustment of site boundary to minimise use of mixed woodland as temporary works area. In particular, the woodland habitat in temporary works area of the Eastern Portal will be avoided, thereby greatly reducing the area of temporary loss of woodland habitat.</li> <li>• Minimizing felling of large trees.</li> <li>• About 20% of trees within the works area will be transplanted. The individual of <i>Artocarpus hypargyreus</i> recorded within the temporary works area of HKU1, if to be encroached, would also be transplanted.</li> </ul>	<p>^</p> <p>^</p> <p>^</p> <p>^</p>
	<p>Standard site practices including the following, should be enforced to minimise the disturbance to the surroundings:</p> <ul style="list-style-type: none"> <li>• Treat any damage that may occur to large individual trees in the adjacent area using materials and methods appropriate for tree surgery.</li> <li>• Reinstate work sites/disturbed areas immediately after completion of the construction works, in particular, through on-site tree/shrub planting along the woodland and shrubland section within the temporary works area. Tree/shrub species used should make reference from those in the surrounding area.</li> <li>• Regularly check the work site boundaries to ensure that they are not exceeded and that no damage occurs to surrounding areas.</li> </ul>	<p>^</p> <p>^</p> <p>^</p>
	<p>A total of 1.02 ha would be replanted with woodland species, reaching almost a 1.5:1 ratio for compensatory planting. Tree/shrub species used should be based on those in the surrounding areas, including those which are commonly recorded during the baseline surveys.</p>	<p>^</p>
	<p>A low-flow channel would be provided within the channelised section to maintain a deeper water depth in the expanded channel, in particular during dry season as well as a basin at the end of the channelised section to provide living space for aquatic life. Step chute in the form of a series of descending water pools would be constructed between the low flow channel and the undisturbed stream course. There would also be openings for aquatic fauna between each chute step (pool). These could work like a “ladder” to help avoid isolating the aquatic fauna in the channelised section from natural habitats.</p>	<p>^</p>
	<p>Measures are also needed to maintain the flow of all affected streams/nullahs during the construction stages. Temporary bypass should be provided if the stream/nullah flows will be cut off by the construction works. After the construction works are finished, sections of temporary loss should be reinstated. Construction materials, wastes, and equipment should be cleared from the sites.</p>	<p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
	<p>Surveys of amphibians at E4(P), PFLR1(P), W12(P), MB16, E5(B)(P), TP789(P) and P5(P) prior to commencement of construction is recommended. Frogs, including Hong Kong Cascade Frog and Lesser Spiny Frog, and tadpoles found at work areas of these proposed intake points will be collected and translocated to nearby streams that will not be affected by the project. These procedures should be performed by experienced herpetologists. A detailed translocation proposal will be submitted during the detailed design stage.</p> <p>Measures should also be taken to avoid runoff to streams and marine habitats. Stream/channel which could potentially be affected during construction should be prevented from sedimentation by erection of sediment barriers. Site runoff should be desilted by siltation traps in streams/channels or diverted, to reduce the potential for suspended sediments, organics and other contaminants to enter the local stream environment.</p>	<p>^</p> <p>^</p>
<b>Marine Ecology</b>	<p>Silt curtains will be deployed during the construction and demolition of the temporary berthing point. Deployment of silt curtains around the berthing point area would effectively avoid adverse water quality impacts due to barge filling. No significant ecological impact is anticipated.</p> <p>The invert of the stilling basin would be at -5.4 mPD. A cofferdam in the form of pipe-pile wall is to be constructed outside the stilling basin prior to the construction of basin. The cofferdam will be dewatered to provide a working area for construction of the stilling basin. The boulders from the seawall will then be removed by landbased grabs.</p> <p>Although the speed of the working vessels to be used in the Project (mainly barges) would not be high, a speed limit for marine traffic is proposed as a precautionary measure. A speed limit of 10 knots should be strictly enforced in the works area, in particular in the waters between the outfall location and the navigation channel in East Lamma Channel.</p>	<p>N/A</p> <p>^</p> <p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.



Types of Impacts	Mitigation Measures	Status
Landscape and Visual	The proposed landscape and visual mitigation measures during the construction phase include:	
	CM1 - Topsoil, where identified, should be stripped and stored for re-use in the construction of the soft landscape works, where practical.	^
	CM2 - Existing trees to be retained on site should be carefully protected during construction. The detailed proposal for any trees felling and transplantation is subject to Lands Department's approval on tree felling application at the detailed design stage.	^
	CM3 - Trees unavoidably affected by the works should be transplanted where practical.	^
	CM4 - Compensatory tree planting should be provided to compensate for felled trees.	^
	CM5 - The extent of disturbance on the existing stream course should be minimized. Any temporary works areas within the stream course shall be reinstated after construction.	^
	CM7 – Control of night-time lighting	^
	CM8 – Erection of decorative screen hoarding	^

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
Cultural Heritage	<p>The Cultural Heritage Impact Assessment has identified the following resources which will require mitigation measures during the construction stage;</p>	
	<p><u>Haw Par Mansion (including boundary wall and gate)</u>  A condition survey must be undertaken by a qualified professional prior to the commencement of construction works for the tunnel portal in order to assess the structural integrity of the mansion, wall and gate (with special attention paid to any fragile architectural features). A report containing description of the types of construction, identification of fragile elements, an appraisal of the condition and a photographic record must be prepared. The report must also provide an assessment indicating whether further precautionary measures will be necessary during the construction phase, and if so provide details for sufficient protective measures, including monitoring for vibration control to ensure that no damage to the structure and fabric of the house, wall and gate results from the construction works. The report must be submitted to AMO for approval before construction activities commence. Upon approval the appropriate monitoring and precautionary measures shall be put into place.</p>	^
	<p>A buffer zone with a minimum width of 3 metres and an obstruction free access point must be maintained between the boundary wall/gate and the temporary works area (during construction works associated for both the tunnel portal and the permanent vehicle access ramp). This is to enable access for routine maintenance works on the wall and to ensure that the wall is not damaged by machinery operation or related construction activities. The temporary works area will be enclosed by standard DSD site hoarding.</p>	^
	<p><u>Former Explosive Magazine of Victoria Barracks</u>  A condition survey must be undertaken by a qualified professional prior to the commencement of construction works in order to assess the structural integrity of the retaining wall and the extent of damage from cracks and vegetation growth. A report containing a description of the wall's construction materials, identification of fragile and/or endangered elements, an appraisal of the condition and a photographic record of the retaining wall must be prepared. The report must also provide an assessment indicating whether further precautionary measures will be necessary during the construction phase, and if so provide details for sufficient protective measures, such as monitoring for vibration control, to ensure that no damage to the retaining wall results from the construction works. The report must be submitted to AMO for approval before construction activities commence. Upon approval the appropriate monitoring and precautionary measures shall be put into place.</p> <p>A buffer zone with a minimum width of 3 metres and an obstruction free access point must be maintained between the retaining wall and the temporary works area (for the duration of the construction phase). The works area will be enclosed by standard DSD site hoarding.</p>	^

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

Types of Impacts	Mitigation Measures	Status
<b>Fisheries</b>	<p>Silt curtain will be deployed during the construction and demolition of the temporary berthing point. With the deployment of silt curtains around the berthing point area, adverse water quality impact associated with the filling would not be anticipated. No significant fisheries impact is anticipated.</p> <p>The invert of stilling basin will be found at -5.4 mPD. A cofferdam in the form of pipe-pipe wall is to be constructed outside the stilling basin prior to the construction of basin. The cofferdam will be dewatered to provide a working space for the construction of stilling basin. The boulders from the seawall will then be removed by landbased grabs.</p>	<p>N/A</p> <p>^</p>
<b>Hazard to Life</b>	<p>There will be no overnight storage of explosives for this project. Transportation of explosives to site for the construction of adit will be undertaken on a daily basis. The contractor is required to destroy any unused explosives before nightfall. If contractor wishes to set up magazines for overnight storage of explosives, it is necessary to carry out risk assessment and seek the relevant approval following the EIAO process.</p>	<p>^</p>

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;  
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;  
\* Recommendation was made during site audit but improved/rectified by the contractor;  
# Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

---

---

**APPENDIX G**  
**SITE AUDIT SUMMARY**

---

---

## Appendix G Summary of Observation and Recommendation Made during Site Inspection

### Summary of Observation and Recommendation Made during Site Inspection in April 2012

Parameters	Date	Observations and Recommendations	Follow-up
<b>Water Quality</b>	12/04/2012	Desilting facilities should be provided to wastewater before entering the public channel at EP and W3.	Rectification/improvement was observed during the follow-up audit session.
	19/04/2012	Mud water was observed discharged into public channel at MBD2. The Contractor was reminded to provide desilting facilities before discharging.	Follow-up action is needed to be reviewed in next reporting month.
	25/04/2012	Cover the exposed slope at Eastern Portal to prevent flushing during rainy season.	Follow-up action is needed to be reviewed in next reporting month.
	25/04/2012	Provide sand bag bunding at intake E5A.	Follow-up action is needed to be reviewed in next reporting month.
<b>Waste/Chemical Management</b>	19/04/2012	Stockpile of rock and sediment was observed at the public road at Intake M3. The Contractor was reminded to clear it as soon as possible.	Follow-up action is needed to be reviewed in next reporting month.
<b>Reminders</b>	05/04/2012	To avoid the blockage of the drainage channel at Intake PFLR1, W10, P5, B2, THR2 and DG1.	Follow-up action is needed to be reviewed in next reporting month.
	05/04/2012	Provide enclosure with three-sides and top shelter before commencement of grouting works at Intake P5.	Follow-up action is needed to be reviewed in next reporting month.
	05/04/2012	To remove the construction materials at near the tree at Intake B2.	Rectification/improvement was observed during the follow-up audit session.
	05/04/2012	To provide sand bag bunding near the site entrance at Intake E5A.	Follow-up action is needed to be reviewed in next reporting month.
	05/04/2012	To clear the concrete deposited in the wheel-washing bay at Intake HR1.	Rectification/improvement was observed during the follow-up audit session.
	12/04/2012	To clear the drainage channel at WP, EP, intake W10 and TP4.	Follow-up action is needed to be reviewed in next reporting month.
	12/04/2012	To clear the broken sand bags at intake B2.	Follow-up action is needed to be reviewed in next reporting month.
	12/04/2012	To clear the construction material near the gullies at M3.	Follow-up action is needed to be reviewed in next reporting month.
	12/04/2012	To remove the construction material near the tree roots at intake W1.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	Clear the discarded leaves at the drainage channel at Intake W10 and Intake TP4.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	Provide drip tray for chemical containers at Intake W10.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To treat the standing water at Intake W10 properly.	Follow-up action is needed to be reviewed in next reporting month.

<b>Parameters</b>	<b>Date</b>	<b>Observations and Recommendations</b>	<b>Follow-up</b>
	19/04/2012	To remove construction materials at near the tree at Intake MA14.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	Provide sedimentation facilities for treating muddy water at Intake M3.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	Clear the deposited silt and sediment at the drainage channel at WP.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To remove the construction materials near the gullies at Intake M3.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To provide drip tray and labels for chemical containers at EP.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To provide drip tray for chemical container at E5A.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To remove stagnant water in H-pile at E7 properly.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To clear the mud in the sedimentation tank at DG1.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	Clear the concrete deposited at the wheel washing bay and drainage channel at HR1.	Follow-up action is needed to be reviewed in next reporting month.
	19/04/2012	To provide drip tray and clear the oil stain at W0.	Follow-up action is needed to be reviewed in next reporting month.
	25/04/2012	Clear the stagnant water at H-pile at E7.	Follow-up action is needed to be reviewed in next reporting month.
	25/04/2012	Cover the dusty stockpile at Western Portal.	Follow-up action is needed to be reviewed in next reporting month.
	25/04/2012	Clear the drainage channel and avoid blockage at Western Portal.	Follow-up action is needed to be reviewed in next reporting month.
	25/04/2012	Remove the stagnant water in the drip tray at Eastern Portal.	Follow-up action is needed to be reviewed in next reporting month.

## Summary of Observation and Recommendation Made during Site Inspection in May 2012

Parameters	Date	Observations and Recommendations	Follow-up
<b>Water Quality</b>	03-05-2012	Silty water was observed discharged into natural stream directly at W1. The Contractor was reminded to provide desilting facilities to silty water.	Rectification/improvement was observed during the audit session on 17 May 2012.
	10-05-2012	The gullies at M3 were observed blocked by construction material. The Contractor is reminded to maintain the drainage properly.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	The wheel-washing bay and the drainage were observed deposited by concrete at HR1. The Contractor should ensure that they function properly.	Follow-up action is needed to be reviewed in next reporting month.
	17-05-2012	The drainage was observed blocked by concrete at HR1.	Follow-up action is needed to be reviewed in next reporting month.
<b>Air Quality</b>	03-05-2012	Dust generation was observed during the rock breaking works at WP. The Contractor was reminded to provide dust mitigation measures properly.	Rectification/improvement was observed during the follow-up audit session.
<b>Reminders</b>	03-05-2012	Clear the discarded leaves at the drainage channel at Intake W10.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	Provide drip tray for the chemical containers at Intake W10.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	To remove the construction materials at near the tree at Intake MA14.	Follow-up action is needed to be reviewed in next reporting month.
	03-05-2012	Provide sedimentation facilities at Intake M3 to avoid direct discharge of wastewater.	Rectification/improvement was observed during the follow-up audit session.
	03-05-2012	Provide drip tray for the air compressor at Intake B2.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	Properly maintain the existing drainage system at Intake M3.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	Clear the used cement bags at Intake SMH17.	Rectification/improvement was observed during the follow-up audit session.
	03-05-2012	Clear the site exit and avoid the muddy water discharging to the public road at Intake W3.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	Provide drip tray at EP to chemical containers.	Rectification/improvement was observed during the follow-up audit session.
	03-05-2012	Clear the stagnant water in drip tray at EP and BR5.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	To repair the broken drip tray and provide drip tray to chemical container at W1.	Rectification/improvement was observed during the audit session on 17 May 2012.
	03-05-2012	Provide drip tray to chemical container at W0.	Rectification/improvement was observed during the audit session on 17 May 2012.
	10-05-2012	To clear the stagnant water at Western Portal.	Rectification/improvement

Parameters	Date	Observations and Recommendations	Follow-up
			was observed during the follow-up audit session.
	10-05-2012	To provide drip tray for chemical container at Western Portal.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	Clear the concrete deposited at the drainage at W10.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	Provide drip tray for chemical containers at W10.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	Clear the oil stain and avoid chemical leakage from mechanical plants at P5.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	To remove the construction material near the tree at MA14.	Follow-up action is needed to be reviewed in next reporting month.
	10-05-2012	Remove the water in the drip tray at MA14.	Rectification/improvement was observed during the audit session on 24 May 2012.
	10-05-2012	Clear the discarded leaves in the drainage at M3.	Rectification/improvement was observed during the audit session on 24 May 2012.
	10-05-2012	To clear the stagnant water in drip tray at Eastern Portal.	Rectification/improvement was observed during the audit session on 24 May 2012.
	10-05-2012	Clear the site exit and avoid muddy water discharging to public road at W3.	Follow-up action is needed to be reviewed in next reporting month.
	10-05-2012	Clear the drainage channel at BR6.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	Provide drip tray for chemical container at W0.	Rectification/improvement was observed during the follow-up audit session.
	10-05-2012	Treat the standing water properly at W10.	Rectification/improvement was observed during the follow-up audit session.
	17-05-2012	To remove the chemical container at near the tree at Intake PFLR1.	Rectification/improvement was observed during the follow-up audit session.
	17-05-2012	To clear the construction materials at near the tree at Intake RR1 and MA14.	Follow-up action is needed to be reviewed in next reporting month.
	17-05-2012	Clear the discarded leaves at the U-channel at Intake M3.	Rectification/improvement was observed during the follow-up audit session.
	17-05-2012	To clear the stagnant water in drip tray in Eastern Portal and Intake MA14.	Rectification/improvement was observed during the follow-up audit session.
	17-05-2012	To remove the mud and the discarded leaves in the sedimentation tank at Intake DG1.	Follow-up action is needed to be reviewed in next reporting month.
	17-05-2012	To repair the broken drip tray at Intake W1.	Rectification/improvement was observed during the follow-up audit session.
	17-05-2012	To provide drip tray for chemical container at	Rectification/improvement



<b>Parameters</b>	<b>Date</b>	<b>Observations and Recommendations</b>	<b>Follow-up</b>
		Intake W1.	was observed during the follow-up audit session.
	17-05-2012	To remove the construction waste at near the tree at Intake W1.	Follow-up action is needed to be reviewed in next reporting month.
	17-05-2012	Clear the muddy access at Intake BR4.	Rectification/improvement was observed during the follow-up audit session.
	24-05-2012	Clear the stagnant water at the drainage channel at the exit of Eastern Portal.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	To replace the worn sand bags for water diversion at Eastern Portal.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	Clear the sedimentation tank at Intake E5A and HR1.	Rectification/improvement was observed during the follow-up audit session.
	24-05-2012	Clear the drainage channel connected to the sedimentation tank at Intake E7.	Rectification/improvement was observed during the follow-up audit session.
	24-05-2012	Clear the waste materials at the pit area for wheel washing at Intake DG1.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	To place the chemical containers at the drip tray properly at Intake DG1.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	To avoid direct discharge of muddy water to public drain at Intake HR1.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	Clear the drainage channel at Intake W0.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	To clear the construction material at near the tree at Intake MA14.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	To clear the construction material at the U-channel at Intake M3.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	Cover the stockpile properly at Intake MA14 and RR1.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	Clear the drainage properly at Intake W10.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	Properly remove the chemical oil in the drip tray at Intake P5.	Follow-up action is needed to be reviewed in next reporting month.
	24-05-2012	Properly clear the chemical leakage at Intake W8.	Follow-up action is needed to be reviewed in next reporting month.

## Summary of Observation and Recommendation Made during Site Inspection in June 2012

Parameters	Date	Observations and Recommendations	Follow-up
<b>Water Quality</b>	01-06-2012	Mud water was observed deposited out of the site boundary on the public road at Intake E5A.	Rectification/improvement was observed during the audit session on 28 June 2012.
	14-06-2012	Muddy water was observed directly pumping out to the existing drain at Eastern Portal. The Contractor was reminded to provide desilting facilities to treat the silty water.	Rectification/improvement was observed during the follow-up audit session.
	14-06-2012	Muddy water was observed almost overflow at Intake HR1. The Contractor was reminded to provide water diversion for the runoff discharge at the upstream.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	Muddy water was observed discharging to the public area at Intake HR1. The Contractor was reminded to provide water quality mitigation measures (e.g. Cover the exposed slope, sand bag protection, etc) properly.	Follow-up action is needed to be reviewed in next reporting month.
<b>Air Quality</b>	14-06-2012	Mud trail was observed at the site exit of Eastern Portal. The Contractor was reminded to provide wheel washing for the vehicle before leaving the site.	Rectification/improvement was observed during the follow-up audit session.
	21-06-2012	Grey smoke emitted from the concreting machine at Intake W5. The Contractor was reminded to check and repair the plant regularly.	Follow-up action is needed to be reviewed in next reporting month.
<b>Waste/Chemical Management</b>	07-06-2012	Construction waste and debris are observed deposited in the stream near Intake MA14. The Contractor should ensure minimum impact is brought to local ecology.	Rectification/improvement was observed during the audit session on 21 June 2012.
<b>Reminders</b>	07-06-2012	Clear the general refuse at Western Portal.	Follow-up action is needed to be reviewed in next reporting month.
	07-06-2012	Provide drip tray to chemical container at Western Portal and Eastern Portal.	Follow-up action is needed to be reviewed in next reporting month.
	07-06-2012	Remove the construction material near the tree at Intakes PFLR1 and MA14.	Follow-up action is needed to be reviewed in next reporting month.
	07-06-2012	Clear the drainage channel at Intake W10.	Follow-up action is needed to be reviewed in next reporting month.
	07-06-2012	Properly clear the chemical leakage at Intake W8.	Rectification/improvement was observed during the follow-up audit session.
	07-06-2012	To clear the construction material at U-channel at Intakes M3 and E7.	Follow-up action is needed to be reviewed in next reporting month.
	07-06-2012	Properly remove the chemical oil in the drip tray at Intake P5.	Rectification/improvement was observed during the audit session on 21 June 2012.
	07-06-2012	To replace the worn sand bags for water diversion at Eastern Portal.	Rectification/improvement was observed during the audit session on 21 June 2012.
	07-06-2012	Clear the sand and mud water deposited on the public road at Intake E5A.	Rectification/improvement was observed during the follow-up audit session.

<b>Parameters</b>	<b>Date</b>	<b>Observations and Recommendations</b>	<b>Follow-up</b>
	07-06-2012	To remove the construction waste at near the tree at Intake W1.	Follow-up action is needed to be reviewed in next reporting month.
	07-06-2012	Remove the concrete and debris in the U-channel at Intake BR6.	Follow-up action is needed to be reviewed in next reporting month.
	14-06-2012	Clear the drainage channel at Intake W10, M3, E7 and BR6.	Follow-up action is needed to be reviewed in next reporting month.
	14-06-2012	Clear the chemical oil at the drip tray at Intake P5 and SMH17.	Follow-up action is needed to be reviewed in next reporting month.
	14-06-2012	To remove the construction materials at near the trees at Intake RR1, MA14 and W1.	Follow-up action is needed to be reviewed in next reporting month.
	14-06-2012	Clear the used cement bags at Intake M3.	Rectification/improvement was observed during the follow-up audit session.
	14-06-2012	Clear the damage sand bags at Eastern Portal.	Rectification/improvement was observed during the follow-up audit session.
	14-06-2012	Clear the construction wastes at near the stream at Intake MA14.	Rectification/improvement was observed during the follow-up audit session.
	14-06-2012	Properly cover the exposed slope at Intake W3.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	To provide drip tray for the chemical containers at Intake W10, W8, W5 and DG1.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	Clear the stagnant water at the drip tray at Intake MA14, MBD2 and SMH17.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	To remove the construction materials at near the trees at Intake MA14 and W1.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	Clear the drainage channel at Intake MA14, M3, MBD2 and DG1.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	To replace the worn sand bags at Intake E5A.	Follow-up action is needed to be reviewed in next reporting month.
	21-06-2012	To avoid pumping the site discharge to the existing drain directly at Intake E5A.	Rectification/improvement was observed during the follow-up audit session.
	21-06-2012	Clear the used cement bags at Intake HR1.	Follow-up action is needed to be reviewed in next reporting month.
	28-06-2012	To provide proper labels for chemical containers at Eastern Portal.	Follow-up action is needed to be reviewed in next reporting month.
	28-06-2012	Clear properly the used cement bags at Eastern Portal.	Follow-up action is needed to be reviewed in next reporting month.
	28-06-2012	To provide sand bags along the site boundary near the site access at Intake E5A.	Follow-up action is needed to be reviewed in next reporting month.

<b>Parameters</b>	<b>Date</b>	<b>Observations and Recommendations</b>	<b>Follow-up</b>
	28-06-2012	To replace or remove the worn sand bags at Intake E5A.	Follow-up action is needed to be reviewed in next reporting month.

---

---

**APPENDIX H  
SUMMARY STATUS OF  
ENVIRONMENTAL LICENCES AND  
PERMITS**

---

---

## Appendix H - Summary of Environmental Licensing and Permit Status

Permit No.	Valid Period		Details	Status
	From	To		
<b>Environmental Permit (EP)</b>				
FEP-01/272/2007/B	25/6/09	N/A	Construction of a 6.25m-7.25m in diameter and about 11 km long underground main drainage tunnel, 2 portals and a series of connecting adits and drop shafts.	Valid
<b>Effluent Discharge License</b>				
EP860/W10/XY0175	23/06/08	30/06/13	Industrial discharge (Area of Mount Butler Office)	Valid
EP860/W10/XY0177	23/06/08	30/06/13	Industrial discharge (Eastern Portal Site)	Valid
EP820/W9/XT086	22/07/08	31/07/13	Industrial discharge (Western Portal Site)	Valid
WT00005864-2010	20/01/10	31/01/15	Industrial discharge (Western Portal Site)	Valid
EP860/W10/XY0183	19/11/08	30/11/13	Industrial discharge (Intake W0, Stubbs Road, Wan Chai, HK)	Valid
WT00003737-2009	-	31/5/14	Industrial discharge (Intake MB16)	Valid
WT00004126-2009	-	31/5/14	Industrial discharge (Intake HKU1)	Valid
WT00003738-2009	-	31/5/14	Industrial discharge (Intake THR2)	Valid
WT00004270-2009	-	31/7/14	Industrial discharge (Intake PFLR1)	Valid
WT00004806-2009	-	30/09/14	Industrial discharge (Intake E7)	Valid
WT00004808-2009	-	30/09/14	Industrial discharge (Intake MBD2)	Valid
WT00004885-2009	-	30/09/14	Industrial discharge (Intake RR1)	Valid
WT00005135-2009	-	31/10/14	Industrial discharge (Intake W10)	Valid
WT00005374-2009	-	30/11/14	Industrial discharge (Intake P5)	Valid
WT00005376-2009	-	30/11/14	Industrial discharge (Intake TP4)	Valid
WT00005357-2009	-	30/11/14	Industrial discharge (Intake W5)	Valid
WT00005588-2009	-	31/12/14	Industrial discharge (Intake TP5)	Valid
WT00005643-2009	-	31/12/14	Industrial discharge (Intake E5A)	Valid
WT00005754-2010	-	31/01/15	Industrial discharge (Intake W8)	Valid
WT00005954-2010	-	28/02/15	Industrial discharge (Intake TP789)	Valid
WT00005915-2010	-	31/01/15	Industrial discharge (Intake E5B)	Valid
WT00006102-2010	-	28/02/15	Industrial discharge (Intake M3)	Valid
WT00006415-2010	-	30/04/15	Industrial discharge (Intake MA15)	Valid
WT00006420-2010	-	30/04/15	Industrial discharge (Intake MA17)	Valid
WT00006428-2010	-	30/04/15	Industrial discharge (Intake BR6)	Valid
WT00006609-2010	-	31/05/15	Industrial discharge (Intake HR1)	Valid
WT00006559-2010	-	30/04/15	Industrial discharge (Intake CR1)	Valid

Permit No.	Valid Period		Details	Status
	From	To		
WT00006929-2010	-	30/06/15	Industrial discharge (Intake W1)	Valid
WT00006418-2010	-	30/06/15	Industrial discharge (Intake MA14)	Valid
WT00006865-2010	-	30/06/15	Industrial discharge (Intake BR5)	Valid
WT00007039-2010	-	31/07/15	Industrial discharge (Intake DG1)	Valid
WT00007042-2010	-	31/07/15	Industrial discharge (Intake W3)	Valid
WT00007043-2010	-	31/07/15	Industrial discharge (Intake GL1)	Valid
WT00007130-2010	-	31/07/15	Industrial discharge (Intake BR4)	Valid
WT00007139-2010	-	31/07/15	Industrial discharge (Intake BR6) – SMH17	Valid
WT00007319-2010	-	31/08/15	Industrial discharge (Intake B2)	Valid
<b>Registration of Chemical Waste Producer</b>				
5213-148-D2393-02	---	N/A	Chemical waste types: Spent oil	Valid
5213-172-D2393-01	---	N/A	Chemical waste types: Spent oil	Valid
<b>Construction Noise Permit (CNP)</b>				
GW-RS0969-11	24/10/11	23/04/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at Hong Kong West Drainage Tunnel (Eastern Portal) (DSD Contract No. DC/2007/10), Tai Hang Road, Causeway Bay, Hong Kong.	Expired
GW-RS0308-12	24/04/12	23/10/12		Valid
GW-RS1036-11	16/11/11	02/05/12		Expired
GW-RS0419-12	03/05/12	02/11/12		Valid
GW-RS0358-12	04/04/12	23/06/12		Expired

Permit No.	Valid Period		Details	Status
	From	To		
GW-RS0077-12	19/02/12	18/08/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work at Section of Pokfulam Road (near Football Field, Pokfulam Road Playground), Hong Kong	Valid
GW-RS0222-12	03/03/12	20/08/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at main tunnel and adits of Hong Kong West Drainage Tunnel under Wan Chai, Hong Kong.	Valid
GW-RS0104-12	18/02/12	17/08/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at Main tunnel and adits of Hong Kong West Drainage Tunnel under construction in Central & Western District, Hong Kong.	Valid
GW-RS1009-11	23/11/11	22/05/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at an area near the junction of Bowen Road and Wan Chai Gap Road, Wan Chai, Hong Kong	Expired
GW-RS0457-12	23/05/12	22/11/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at an area near Lover's Stone Garden at Bowen Road, Wan Chai, Hong Kong.	Valid
GW-RS1008-11	23/11/11	22/05/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at an area near	Expired
GW-RS0465-12	23/05/12	22/11/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at an area outside Hongkong Electric Centre, Kennedy Road, Hong Kong.	Valid
GW-RS1050-11	30/11/11	30/05/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at an area outside Hongkong Electric Centre, Kennedy Road, Hong Kong.	Expired
GW-RS0510-12	30/05/12	29/11/12	Construction Noise Permit for the use of powered mechanical equipment for carrying out construction work and performing prescribed construction work at an area outside Hongkong Electric Centre, Kennedy Road, Hong Kong.	Valid



---

---

**APPENDIX I**  
**WASTE GENERATED QUANTITY**

---

---

### Monthly Waste Flow Table

Quarter ending	Actual Quantities of Inert C&D Materials Generated Monthly <sup>(1)(3)</sup>						Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated	Broken Concrete <sup>(8)</sup>	Reused in the Contract	Reused in other Projects <sup>(4)(5)</sup>	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics <sup>(2)</sup>	Chemical Waste	Others, e.g. general refuse
	( in m <sup>3</sup> )	( in m <sup>3</sup> )	( in m <sup>3</sup> )	( in m <sup>3</sup> )	( in m <sup>3</sup> )	( in m <sup>3</sup> )	( in Kg)	( in Kg)	( in Kg)	( in Kg)	( in m <sup>3</sup> )
Jan-12	1694	53	0	791	850	0	19030	280	0	0	190
Feb-12	1099	72	0	0	1027	0	62340	350	0	4362	258
Mar-12	3607	43	0	0	3564	0	44780	245	0	0	302
Apr-12	1372	14	0	0	1358	0	247570	210	0	3369	291
May-12	4532	115	0	0	4417	0	89440	245	0	0	442
Jun-12	2745	69	0	0	2676	0	305480	350	0	1200	403
Sub-Total	15049	366	0	791	13892	0	768640	1680	0	8931	1886
Jul-12											
Aug-12											
Sep-12											
Oct-12											
Nov-12											
Dec-12											
Total <sup>(6)(7)</sup>	15049	366	0	791	13892	0	768640	1680	0	8931	1886

- Notes:
- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
  - (2) Plastics refer to plastic bottles/containers, plastic/foam from packaging material.
  - (3) Quantities in Jun 2012 are upto 30 Jun 2012.
  - (4) Assuming the conversion factor from m<sup>3</sup> to ton for rock is 2.5.
  - (5) The materials reused in other Project shall not be treated as waste under the Waste Disposal Ordinance (Cap 354).
  - (6) The figures are included for the sake of completeness of record.
  - (7) The figures in blue font are the prediction quantities, which are not included in the "Total" quantities.
  - (8) Unless states otherwise, the broken concrete is disposed as public fill in PFRFs.

---

---

**APPENDIX J**  
**SUMMARY OF EXCEEDANCES**

---

---

## **Contract No. DC/2007/10 – Design and Construction of Hong Kong West Drainage Tunnel**

### **Exceedance Report**

#### **Eastern Portal**

- (A) Exceedance Report for Air Quality (1 hour TSP)  
(NIL in the reporting quarter)**
- (B) Exceedance Report for Air Quality (24 hours TSP)  
(NIL in the reporting quarter)**
- (C) Exceedance Report for Construction Noise  
(Four Action Level exceedances were recorded for the complaints received on 14 May, 4 and 18 June 2012)**

#### **Western Portal**

- (D) Exceedance Report for Air Quality (1 hour TSP)  
(NIL in the reporting quarter)**
- (E) Exceedance Report for Air Quality (24 hours TSP)  
(NIL in the reporting quarter)**
- (F) Exceedance Report for Construction Noise  
(Two Action Level exceedances were recorded for the complaints received on 1 May and 2 June 2012)**
- (G) Exceedance Report for Water Quality  
(NIL in the reporting quarter)**

#### **Intakes**

##### **Intake BR6**

- (H) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake DG1**

- (I) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake E5A**

- (J) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake E7**

- (K) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake MA14**

- (L) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake PFLR1**

- (M) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake RR1**

- (N) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

##### **Intake THR2**

**(O) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

**Intake W0**

**(P) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

**Intake W5**

**(Q) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

**Intake W8**

**(R) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

**(S) Exceedance Report for Construction Ground borne Noise  
(NIL in the reporting quarter)**

**Intake P5**

**(T) Exceedance Report for Construction Noise  
(NIL in the reporting quarter)**

---

---

**APPENDIX K  
COMPLAINT LOGS**

---

---

**APPENDIX L – COMPLAINT LOG**

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
Com-2008-05-003	Construction site at Eastern Portal	22 May 2008	The complaint was lodged by a complainant on 22 May 2008 regarding noise nuisance generated from the construction activities at the construction site of Eastern Portal	<p>According to the Contractor, only one excavator and one generator were operated for the excavation works around 8 am on 22 May 2008 at the Eastern portal. No other construction activities were conducted.</p> <p>In response to the complaint, The Contractor agreed to reschedule their current works activities, with immediate effect from 23 May 2008, that only site preparation works without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at the Eastern Portal area.</p> <p>Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in May and (2) no non-compliance or observation on noise was recorded.</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
Com-2008-05-004	Construction site at Western Portal (Marine Works)	31 May 2008	The complaint was lodged by one of the local resident on 31 May 2008 regarding the noise nuisance generated from the marine works at Western Portal.	According to the Contractor, only two derrick barges and one tug boat were operated for the seabed formation works around 18:00 hrs on 31 May 2008 at the Western Portal. No other construction activities were conducted.  Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in May and (2) no non-compliance or observation on noise was recorded.	Closed
Com-2008-07-007	Construction site at Eastern Portal	2 July 2008	The complaint was lodged by a resident of The Legend on 2 July 2008 regarding noise nuisance generated from the construction activities at the construction site of Eastern Portal	According to the Contractor, only one generator and one drilling rig (Jumbo) were operated for the preparation works around 7:30a.m on 2 July 2008 at the Eastern portal. Construction noise was found from other construction site (Gammon Construction Limited) adjacent to Eastern Portal area.	Closed



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>In response to the complaint, The Contractor review his forthcoming operations within the Eastern Portal site as previous they agreed, reschedule their current works activities, with immediate effect from 23 May 2008, that only site preparation works without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at the Eastern Portal area.</p> <p>Additional noise monitoring was conducted on 16 and 17 July 2008 during the drilling rig (Jumbo), excavator and wheel loader were operated for drilling works.</p> <p>Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in June and July 2008 and additional noise monitoring (2) no non-compliance or observation on noise was recorded.</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2008-10-011	Construction site at Western Portal	11 October 2008	The complaint was lodged by one of the resident of Victoria Road on 11 October regarding about the noise nuisance generated from the construction works at Western Portal	<p>According to the Contractor, excavation works and marine works including sheet piling works were also conducted at the time of complaint at Western Portal</p> <p>Additional noise monitoring was conducted on 15 October 2008, drilling works, excavation works and marine works including sheet piling works were also conducted. The construction noise levels measured during the construction works were well below the construction noise limit of 75 dB(A)</p> <p>The Contractor agreed to reschedule the starting time of the construction works to 8:15am on every Saturday that without noise nuisance from the construction works to the nearby residents will be carried out from 7:00 am to 8:15 am at the Western Portal area.</p> <p>Base on the information collected, the noise level measured at outside Aegean Terrace during the construction works at Western Portal site were well below the construction</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				noise limit of 75 dB(A). Also, the Contractor has implemented the remedial measure that reschedule the starting time of the construction works to 8:15am on every Saturday immediately after receiving the complaint to minimize the noise nuisance to the nearby residents.	
COM-2008-10-012	Construction site at Intake TP5	15 October 2008	The complaint was lodged by a complainant on 15 October 2008 regarding about the noise generated from the GI works, which starts from 8:30 hrs to 17:30 hrs next to Aigburth at May Road.	According to the information provided by the Contractor, only rotary type drill rigs and water pumps were operated for the GI works at the time of complaint at Intake TP5.	Closed
COM-2008-10-013	Construction site at Intake TP5	31 October 2008	The complaint was lodged by a complainant on 31 October 2008 regarding the black smoke is emitted and noise is generated from the machine at the site (Intake TP5), he needed to close the windows to prevent the black smoke from entering his flat and to attenuate the noise.	Additional site inspection and noise monitoring at the podium of the Valverde at May Road were conducted on 3 Nov 2008 and 24 Oct, 5 Nov, 7 Nov 2008 respectively.  The Contractor agreed to reschedule the starting time of the construction works to 9:30am on every Saturday and 8:00 on normal weekdays that	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2008-11-015	Construction site at Intake TP5	4 November 2008	The complaint was lodged by a complainant on 4 November regarding the noise nuisance generated from the construction works at Intake TP5.	without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at Intake TP5. Acoustic insulating materials have been applied for enclosing water pump and rotary type drill rigs to minimize the noise nuisance to the nearest residents.  Base on the information collected, the noise level measured at the podium of the Valverde at May Road were well below the construction noise limit of 75 dB(A) after the Contractor has implemented the remedial measure.	
COM-2008-11-016	Construction site at Western Portal	17 November 2008	The complaint was lodged by a complainant on 17 November 2008 regarding dust nuisance arising from the soil nailing works at the roadside slope of Cyberport	According to the information provided by the Contractor, soil nailing works were conducted and some plant equipments i.e air compressor and generator were operated at the time of complaint at Western Portal.  Base on the regular air quality monitoring in November 2008 at Outside Aegean Terrace (AQ2) and Outside The Site Office at Western	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			Road.	Portal (AQ3), the dust levels measured at AQ2 for 1 hour TSP and at AQ3 for 24 hour TSP were well below the Action Level (321µg/m <sup>3</sup> for 1 hour TSP and 156µg/m <sup>3</sup> for 24 hour TSP). Also, the Contractor has implemented the dust suppression measures to prevent dust nuisance from the construction activities including soil nailing works.	
COM-2008-11-019	Construction site at Western Portal	29 November 2008	The complaint was lodged by a complainant on 1 December 2008 regarding noise nuisance at Western Portal at 08:30 hrs approx on 29 November 2008 and 00:30 on 1 December 2008.	According to the information provided by The Contractor, no construction works was carried out at the temporary jetty at the time of complaint (00:30 on 1 December 2008) at Western Portal.  However, base on the regular noise monitoring at Outside Aegean Terrace (NC3), the noise level measured during the construction works at Western Portal site were well below the construction noise limit of 75 dB(A).	Closed
	Construction site at Western Portal			The complaint was considered not justifiable as Construction Noise Permit (CNP) – CNP No. GW-RS0827-08 has been granted from	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2008-12-020		28 December 2008	The complaint was lodged by a complainant on 28 December 2008 regarding the excavator was found working within Western Portal works area on Sunday.	EPD for carrying out the construction works at Hong Kong West Drainage Tunnel (Western Portal), Cyberport Road, Cyberport, Hong Kong (DSD Contract No. DC/2007/10) between 1 December 2008 at 1900 hours and 28 February 2009 at 2400 hours. The powered mechanical equipment can be operated during the hours as below:  a) Any day not being a general holiday between 1900 – 2300 hours b) General holiday ( <b>including Sundays</b> ) between 0700 – 1900 hours	
COM-2009-01-021	Muddy Water Discharged into Sea at Western Portal	21 January 2009	Muddy water was observed from discharging into the sea at Western Portal Site	Base on the information collected, the muddy water discharged into the sea is considered due to the operations of excavation of stilling basin and poor condition of the silt curtain.  The Contractor agreed to review their current provisions to prevent any muddy water from discharging into the sea again and close check the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				condition of the silt curtain.	
COM-2009-01-022(A)	Construction site at Western Portal	12 January 2009	The complaint was lodged by a complainant, the assistant of Southern District Councillor about the resident in Baguio Villa near Victoria Road, the complainant concerns on the noisy activities carried out at Western Portal site.	Base on the information collected, the noise level measured at outside Aegean Terrace during the construction works at Western Portal site were well below the construction noise limit of 75 dB(A). Aegean Terrace is at location close to the major site activities compared with Baguio Vila. Also, The Contractor agreed to reschedule their current works activities, no noisy work will be carried out at Western Portal Site before 8:00a.m.	Closed
COM-2009-01-022(B)		21 January 2009	The complaint was lodged by resident of Aegean Terrace at Sassoon Road about the noise nuisance generated from Western Portal Site.		
COM-2009-01-022(C)		21 January 2009	The complaint was lodged by the resident in Baguio Villa near Victoria Road about noisy works at Western Portal Site.		
COM-2009-02-023	Construction site at Eastern Portal	7 February 2009	Complaint of Construction Noise at Early Morning (07:45hrs) at Eastern Portal	Based on the information collected, the construction noise at about 07:45hrs on 7 February 2009 was due to the checking of the backhole by the sub-contractor.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			Site	The Contractor was reminded to strengthen their site supervision and provide sufficient site-specific environmental training for sub-contractor to ensure that such situation would not be recurred.	
COM-2009-03-025	Construction site at Western Portal	2 March 2009 4 March 2009	Complaint of noise generated by midnight works and night-time lighting at Western Portal Site	Base on the information collected, the regular noise monitoring was conducted during the construction works at the restricted hours. The noise measurement results were well below the construction noise limit of 65dB(A) for the period of 0700-2300 hrs on holiday; and 1900-2300 hrs on all other days and baseline level during the night time.	Closed
COM-2009-03-026		7 March 2009	Complaint of pipe hitting noise at midnight at Western Portal Site.		



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				mitigation measures for Visual during the construction by controlling the night-time lighting so that the residual visual impacts can be accepted.	
COM-2009-04-028	Construction site at Western Portal	7 April 2009	Complaint of noise generated from the construction works conducted till 11:00pm at Western Portal of the Hong Kong West Drainage Tunnel.	According to the information provided by The Contractor, TBM, conveyor belt, ventilation fan, tower crane and cherry picker were operated for the construction works on 7 April 2009 before 11:00pm and only TBM works with conveyor belt and ventilation fan were operated on 10 April 09 (Sunday). No operation of derrick barge on 10 April 09.	Closed
COM-2009-04-029		10 April 2009	Complaint of noise generated by TBM works at Western Portal.		

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>period of 0700-2300 hrs on holiday; and 1900-2300 hrs on all other days and baseline level for the period of 2300-0700 hrs of next day. The ground borne noise levels measured were also well below the construction ground borne noise standards (i.e. 65 dB(A) – Daytime (except General Holiday and Sundays) and 55 dB(A) – Daytime during general holidays and Sunday and all days during Evening (1900 to 2300 hrs). No exceedances of noise level have been recorded in March and April 2009.</p> <p>The Contractor was advised to strictly follow the conditions of the permit to avoid any misplacement of plants in the future. Also, The Contractor should take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report.</p> <p>In addition, DNJV already arranged tailors made training for the Production Team including the</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>senior management and foreman to explain the conditions and requirements listed on the CNP and delegated one Engineer to ensure all construction activities and PMEs to be used are fully complying with CNP and legislation requirements before the commencement of the construction activities during the restricted hour.</p>	
				<p>Base on the information collected, regular noise Monitoring was conducted during the night time to check the noise levels are complying with the construction noise criteria. The noise levels measured at NC3 during the construction works at night time were well below the construction noise limit.</p> <p>The Contractor was reminded to strengthen their site supervision by delegated Engineer to ensure all construction activities and PMEs to be used are fully complying with CNP and legislation requirements and implement necessary noise mitigation measures as</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				recommended in the Approved EIA report to minimize and avoid the construction noise impact to the residents nearby especially during the restricted hours.	
COM-2009-04-030	Construction site at Western Portal	30 April 2009	Complaint of Construction Noise Generated at Night at Western Portal.	According to the site activities diaries, TBM chainage, TBM excavation, installation of segment ring, pea gravel & mortar injection and installation cables & pipes at gantries were the activities conducted in the night of 30 April 2009.  In accordance with the night time visit on 15 May 2009, the noise levels at Aegean Terrace was not high but with occasionally sound of locomotive and tower crane operations.  No exceedance of noise level was recorded since the commencement of the project works at Western Portal Site. The noise levels measured at NC3 during the construction works were well below the construction noise limit.  The Contractor will continue	Closed
COM-2009-05-031		4 May 2009	Complaint of low frequency noise emitted from the construction site at Western Portal.		
		11 May 2009	Complaint of Construction Noise nuisance generated from the Western Portal Site from day to night.		

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				implementing their mitigation measures (e.g. Instruct workers not to shout during work in the evening; no horn signal of locomotive after 6:55 pm).	
COM-2009-05-032	Construction site at Eastern Portal	13 May 2009	The complaint was lodged by a resident regarding the Construction Noise Nuisance from the construction works that were carried out from early morning till night time at Eastern Portal Site Area.	Based on the information collected, the noise levels measured at NC1/NC1a and NC2 during the construction works were well below the construction noise limit or baseline level.  The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents especially during the restricted hours.	Closed
COM-2009-06-035	Hong Kong West Drainage Tunnel Construction Site at Cyberport	3 June 2009	EPD received a public complaint raised by local resident regarding the transportation and disposal of construction wastes from Hong Kong West Drainage Tunnel Construction Site at Cyberport on 3 June 2009.	Base on the information collected, alternative disposal ground is proposed by The Contractor and they have been submitted the relevant information and sought the approval from Supervising Officer. The Contractor also maintains the daily record with details of each disposal trip from the Site and the disposal ground.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2009-06-037	Construction site at Eastern Portal	23 June 2009	The few noise complaints were lodged by a resident of The Legend and Ronsdale Garden regarding the Construction Noise Nuisance from the construction works at Eastern Portal Site Area since 7:00a.m and in the afternoon.	<p>Based on the information collected, the noise levels measured at NC1 and NC2 during the construction works were well below the construction noise limit or baseline level.</p> <p>In response to the complaints, the head of hydraulic breaker has been wrapped with sound proof materials and movable noise barriers were provided for rock excavation to reduce noise.</p> <p>The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents.</p>	Closed
COM-2009-06-038			The complaint was raised by a representative of Goodwell Property Management, she wrote on behalf of the Estate Owner Committe of Legend at Tai Hang about noise nuisance arising from the excacvation works at Eastern Portal site portion. The Committe requested the Contractor to provide mitigation measures to mininise the impact.		
COM-2009-08-040	Construction site at Intake PFLR1	26 August 2009	The complaint was relating to the noise generated from the construction activities of breaking of the existing boundary wall of Pokfulam Road Playground by use of	Noise monitoring results conducted on 1 September 2009 at NC11 - Honey Court for the Intake PFLR1 was submitted and no exceedance was recorded. In addition, based on the regular site inspection conducted	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			the hand-held electric breaker.	<p>at Intake PFLR1, no observation/non-compliance on air quality was identified. The environmental conditions of the site will be continuously reviewed and monitored.</p> <p>DNJV had installed tarpaulin shielding and cover to mitigate not only the potential emission of exhausted smoke, but also the visual impact to the residents nearby.</p>	
COM-2009-09-042	Construction site at Eastern Portal	21 September 2009	The complaint was raised by a resident of The Legend regarding poor housekeeping and construction noise nuisance from the Eastern Portal Site Area.	<p>Based on the information gathered in the Investigation, the Contractor had taken action immediately to rectify the complaint of poor housekeeping. The white site office was painted green in harmony with the surrounding environment and the site was maintained in a clean and tidy condition. All materials required for temporary works were stored in an orderly manner.</p> <p>Regarding the complaint of construction noise impact, the noise levels measured at The Legend</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>(NC2) during the construction works in the normal working hours were well below the construction noise limit level.</p> <p>Nevertheless, the Contractor is also committed to implementing sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents and provide training for the workers to increase awareness of their environmental responsibilities.</p>	
COM-2009-10-044	Construction site at Eastern Portal	6 and 7 October 2009	The complaint was raised by a resident of The Legend and Ronsdale Garden regarding the construction noise nuisance from the Eastern Portal Site Area.	Based on the information gathered in the Investigation, the noise levels measured (additional noise monitoring) at The Legend (NC2) and Ronsdale Garden during the construction works including rock breaking works and soil nailing works were ranged from 68.4dB(A) to 75.3 dB(A) in the normal working hours.	Closed
COM-2009-10-045					



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>recommended in the approved EIA report to minimize the nuisance caused to the nearby residents and provide training for the workers to increase awareness of their environmental responsibilities.</p> <p>It is recommended to increase the construction noise monitoring frequency for Eastern Portal Site to check the mitigation effectiveness.</p>	
COM-2009-11-054	Construction site at Western Portal	23 and 29 November 2009	The complaint was raised by a resident of Aegean Terrace regarding the construction noise nuisance from the Western Portal Site Area.	<p>Base on the information collected, the noise levels measured at NC3 during the construction works were well below the construction noise limit.</p>	Closed
				<p>Nevertheless, the Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report, Clause 5.4.15 to minimize/avoid the nuisance caused to the nearby residents.</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2009-12-059	Construction site at Intake MB16	27 November 2009	The complaint was received on 2 November 2009 regarding the dust nuisance caused by the works at the Construction Site at Mount Butler Road near Clementi Road (Intake MB16). EPD subsequently issued a notice of complaint.	<p>Based on the information collected, the Contractor has implemented the dust suppression measures to prevent dust nuisance from the construction activities.</p> <p>During the site inspection in November 2009, slope improvement works including soil nailing works were observed from other construction site adjacent to DNJV's construction works at Mount Butler Road.</p>	Closed
COM-2009-12-061	Construction site at Intake PFLR1	23 and 28 December 2009	Two public complaints were received from the resident of Pok Fu Lam Road on 23rd and 28th December 2009 respectively about the construction noise nuisance from the construction site at Intake PFLR 1.	<p>Based on the information gathered in the Investigation, the noise levels measured at Honey Court (NC11) during the construction works were well below the construction noise limit.</p> <p>The location of the designated noise monitoring station (NC11 – Honey Court) is at location close to the construction site compared with Pok Fu Lam Height.</p> <p>In addition, a large scale innovation works being undertaken at a resident building adjacent to the Pok Fu Lam Height was observed during the</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>routine site inspection. The innovation works included hammering and drilling on the outer walls of the building and contributed significantly to the noisy environment.</p>	
COM-2010-01-062	Construction site at Western Portal	3 January 2010	<p>The public complaint was received from the resident of Bel-Air through the project hotline on 3rd January 2010 about “wooning” sound heard after midnight, and he suspected that the sound was coming from the construction sites at Cyberport.</p>	<p>Based on the information collected, the noise levels measured at NC3 during the construction works were well below the baseline level. The location of the designated noise monitoring station (NC3 – Outside Aegean Terrace) is at location close to the construction site compared with Bel-Air.</p> <p>The Contractor will continue implementing the existing noise mitigation measures at the Western Portal to minimize the environmental impact to the nearby residents.</p>	Closed
COM-2010-01-063 COM-2010-01-066(1), (2) and (3)	Intake MB16	20 January 2010 23, 25, 27 January and 2 February 2010	<p>The first complaint was raised by the resident at No. 58 Mount Butler Road about the noise and vibration generated from the works on 20 January 2010.</p> <p>Three complaints were raised</p>	<p>Based on the EIA assessment results, No. 58 Mount Butler Road and Amber Lodge are not the potential ground borne noise sensitive receivers as they are not within the influence zone near the Main Tunnel alignments from Cyberport to Tai Hang and the alignments of the adits.</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			by the resident of Amber Lodge through the Project Hotline regarding the low frequent vibration from underground on 23, 25, 27 January and 2 February 2010.	<p>The additional ground borne noise levels measured at inside Amber Lodge during the TBM works were well within the construction ground borne noise standards.</p> <p>The Contractor volunteered to stop the operation of the East TBM between midnight and 07:00 hours in Week 6 and 7 after which the machine has moved far away from these premises</p>	
COM-2010-02-073	Western Portal	3 February 2010	Complaint of noise generated by the operation of plants, rock falling and flash lighting within Western Portal site area.	<p>Base on the regular noise monitoring, the noise levels measured at NC3 during the construction works were well below the baseline level.</p> <p>The Contractor will continue implementing the existing noise mitigation measures at the Western Portal to minimize the environmental impact to the nearby residents.</p>	Closed
COM-2010-03-080	Intake PFLR1	1 March 2010	The public complaint was received from the resident of Honey Court referred by a DC member on 1st March 2010 about the construction	Based on the information gathered in the Investigation, the noise levels measured at Honey Court (NC11) in February and March 2010 were ranged from 62.3 dB(A) to 74.7	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			noise nuisance from the construction site at Intake PFLR 1	<p>dB(A). The noise levels were marginally below the 75dB (A) limit level.</p> <p>The contractor was reminded to implement necessary mitigation measures to curb inducing contribution to the surrounding noise environment.</p>	
COM-2010-03-081	Intake TP789	5 March 2010	The complaint was received from Kerry Management Ltd. on 5th March 2010 about the construction noise complaints raised by some tenants of Tavistock. They complained about the noisy activities being carried out at Intake TP789 on Saturday.	<p>Based on the information gathered in the investigation, the noise levels measured at Tregunter Path near Tavistock were below the construction noise limit and the Contractor has already implemented the noise mitigation measures to reduce noise impact to the residents arising from the construction works.</p> <p>Nevertheless, we reminded the Contractor to closely monitor the effective implementation of the existing noise mitigation measures at Intake TP789. Review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-03-082 and COM-2010-03-087	Western Portal	6 March 2010 15 March 2010	Two public complaints were received from the residents of Bel-Air at Western Portal on 6th and 15th March 2010 about the Construction Noise and Dust Nuisance from Hong Kong West Drainage Tunnel Construction Site at Cyberport (i.e. Western Portal Site) respectively.	Based on the information collected, the noise and air quality levels measured at NC3 and AQ2/AQ3 during the construction works were below the noise and air quality criteria respectively. Also, the Contractor has implemented appropriate environmental mitigation measures on site to reduce noise and dust impact to the residents arising from the construction works.  Nevertheless, the Contractor was reminded to review the effectiveness of the implemented noise and air quality mitigation measures from time to time during different construction phases.	Closed
COM-2010-04-094	Western Portal	9 April 2010	The public complaint was received by EPD hotline on 9 <sup>th</sup> April 2010 regarding construction dust nuisance from the Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site)	Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria. Also, the Contractor has implemented appropriate dust mitigation measures on site to reduce dust impact to the residents arising from the construction works. Although the air quality levels measured at AQ2 and	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>AQ3 were below the air quality criteria, we advised the Contractor to maintain the existing air quality mitigation measures, to reduce the environmental impact on the nearby residents.</p> <p>Nevertheless, the Contractor was reminded to review the existing measures if such measures are enough and appropriate to suit the site condition from time to time during different construction phases to minimize the dust nuisance.</p>	
COM-2010-04-097	Intake TP789/TP4	22 April 2010	The complaint was received from resident of Tregunter Tower on 22 <sup>nd</sup> April 2010 about the noisy activities being carried out at Intake TP789/TP4 in the morning.	<p>Based on the information gathered in the investigation, the noise levels measured at Tregunter Path near Tavistock were below the construction noise limit and the Contractor has further improved the noise mitigation measures to reduce noise impact to the residents arising from the noise generation works.</p> <p>The Contractor agreed to reschedule the starting time of the noisy works to 9:00am on in the morning that no noisy works such as rock breaking</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				will be conducted before 9:00am. In addition, enclosures consist of noise absorption blankets have been applied for enclosing Intakes construction areas to minimize the noise nuisance to the nearest residents.	
COM-2010-04-100	Western Portal	30 April 2010	The public complaint was received from the resident of Bel-Air on 30 <sup>th</sup> April 2010 regarding the dust nuisance generated during loading / unloading operation from two barges at pier of Cyberport. Dark smoke was also emitted from the two barges.	Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria.  The Contractor has taken initiative to minimize dust nuisance to the nearby residents by implementation of additional mitigation measures as below: <ul style="list-style-type: none"> <li>- To plan the installation of 3-sided curtain-like enclosure at the conveyor discharge point to the barge.</li> <li>- Mechanical cover closed even for empty trucks leaving the Site.</li> <li>- Written advice to subcontractor on the subject of dust suppression and speeding of vehicles.</li> <li>- Toolbox training to drivers on the new measures.</li> </ul>	Closed



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-05-105	Western Portal	7 May 2010	The second complaint was received via EPD Hotline on 7 May 2010. The anonymous complainant concerned about the dark smoke emitted from the barges on 4 May 2010 and many dump trucks parking outside the Western Portal Site on 5, 6 and 7 May 2010.	Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria.	Closed
COM-2010-05-105 (2)		17 May 2010	The complaint was received via EPD Hotline on 17 May 2010. The anonymous complainant complaint about the open stockpile of dusty materials without covered entirely.	<p>Although the air quality levels measured at AQ2 and AQ3 were below the air quality criteria, we advised the Contractor to maintain the existing air quality mitigation measures and review the existing measures if such measures are enough and appropriate to suit the site condition from time to time during different construction phases to minimize the dust nuisance.</p> <p>Other suitable dust control measures as stipulated in the Air Pollution Control (Construction Dust) Regulation, where appropriate, should be adopted.</p> <p>Nevertheless, the Contractor is also committed to take sufficient dust mitigation measures as recommended in the approved EIA report including</p>	

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				installation of 3-sided curtain-like enclosure at the conveyor discharge point to the barge to minimize the dust nuisance on the nearby residents.	
COM-2010-06-113	Intake PFLR1	2 June 2010	The complaint was received by DSD on 2 June 2010 regarding siren sound was generated from the site throughout the day which caused nuisance.	The noise source was generated from the alert system of the backhoe during operation. The backhoe was removed off site on 3 June 2010.	Closed
	Western Portal	15 June 2010	A public complaint was received by EPD hotline on 15th June 2010 complained about the construction works from Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site) affect their health of respiratory system	Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the Action Level (321µg/m <sup>3</sup> for 1 hour TSP and 156µg/m <sup>3</sup> for 24 hour TSP). Also, the Contractor has implemented appropriate dust mitigation measures, such as providing water sprays on exposed surface, covering dusty materials and placing dust generation works in an area sheltered on the top and three sides etc on site to reduce dust impact to the residents arising from the construction works.	Closed
COM-2010-07-121	Western Portal	15 July 2010	Cyberport Management Office lodged a complaint in	DNJV has delivered the reply letter to Cyberport Management Office on	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			writing regarding the sands and mud left by the dump trucks on Cyberport road	<p>26 July 2010 stating the following:-                      The stain is not mud or debris. It is liquid of granite powder. Stain on the road was caused by heavy rainstorm which brings moisture to granite powder in trucks.</p> <p>The trucks have been equipped with tailor-made tanks to receive the liquid of granite powder. To prevent reoccurrence, DNJV will reinforce checking of these tanks and other truck conditions at work site to ensure no dripping before departure.</p> <p>In this regard, the Contractor was reminded that all vehicles and plant should be cleaned before leaving the construction site to ensure no earth, mud and debris or other wastes is deposited on roads. Proper maintenance of the tailor-made tanks equipped at the trucks is also needed to avoid any leakage.</p>	
COM-2010-07-123 (1)	Eastern Portal	2 August 2010	The complaint was received through the Project Hotline regarding the noise generated from construction vehicles.	Based on the information collected, the noise levels measured at NC1/NC1a and NC2 during the construction works were well below	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-07-123 (2)		2 August 2010	The complaint was received by DSD concerning the noise generated from construction site at 19:00.	the construction noise limit or baseline level.  The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents especially during the restricted hours.	
COM-2010-08-125		3 August 2010	The complaint was received by DSD concerning the noise generated from construction site until 8:00 pm every night.		
COM-2010-08-124	Intake TP789/TP4	2 August 2010	The complaint was received by DSD regarding the construction works at Tregunter Path is extremely noisy and diminishes the ability of residents of the neighborhood to enjoy outdoor facilities	Based on the information gathered in the investigation, the noise levels at Tregunter Tower was within the construction noise limit of 75dB(A). The Contractor has taken initiative to minimize noise nuisance to the nearby residents by implementation of mitigation measures continuously as below:  <ul style="list-style-type: none"> <li>- Properly maintained and operated the construction plant (well-greased, damage and worn parts promptly replaced)</li> <li>- To install noise absorption blankets at the appropriate area to mitigate noise generated by the works.</li> </ul>	Closed
COM-2010-08-124 (con'd)		5 August 2010	The complaint was received by DSD regarding the construction works at Tregunter Path is extremely noisy and diminishes the ability of residents of the neighborhood to enjoy outdoor facilities		
COM-2010-08-129		12 August 2010	The complaint was raised by the resident of Tregunter Path for the noisy works which		

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			was carried out after 18:00hrs at Intake TP4	- To arrange the construction working period at Tregunter Path starting from 13th August 2010 as below: Monday – Friday: 08:00hrs to 18:00hrs Saturday: 08:30hrs to 18:00hrs Sunday and Public Holiday: No Works	
COM-2010-08-129		12 August 2010	The complaint was received from Protech Property Management Limited (the building manager of Tregunter Tower, 14 Tregunter Path, Mid-Levels, Hong Kong) regarding the noisy construction works at Tregunter Path		
COM-2010-08-129 (2)		13 August 2010	The complaint was received by RSS concerning the noisy work from the construction site on Saturday		
COM-2010-10-151	Eastern Portal	15 October 2010	A complaint was received from the resident of The Legend through the supervising officer on 15th October 2010 about the construction dust nuisance from Eastern Portal Site Area.	Based on the information gathered in the investigation, no exceedance of air quality level was recorded at AQ1 since the commencement of the project works for Eastern Portal Site.  The potential source of air quality impact arising from the removal of tunneling spoils from the tunnel portals as well as the vehicular emissions is minimized as all TBM excavation works have been completed since 5 October 2010.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2010-10-154	Eastern Portal	18 October 2010	<p>A complaint was received from the resident of Ronsdale Garden through the DSD on 18th October 2010 about the construction noise nuisance from Eastern Portal Site Area.</p> <p>According to the complainant, the noise seems to be generated by a pump.</p>	<p>Based on the information gathered in the investigation, the noise levels measured at The Legend (NC2) and outside True Light Middle School of Hong Kong (NC1) were well below the limit level.</p> <p>The Contractor agreed to terminate the operation of pump during the evening (1900 – 2300) and night (2300 – 0700) time since end of October 2010 and committed to implementing sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents.</p>	Closed
COM-2010-10-155	Intake RR1	11 October 2010	<p>A letter from the Property Management of Peakville Court - Hong Yip Service Company Ltd was received by DNJV on 11th October 2010 about the construction noise nuisance and wastewater generated from Intake RR1 Site Area.</p>	<p>Based on the information gathered in the investigation, the noise levels measured at Peakville Court (NC13) and Ying Wa Girl's School (NC12) were below the baseline/limit level.</p> <p>In addition, water runoff was observed leaked out to the public road from the site area according to the regular site inspection.</p> <p>The Contractor will seal the bottom of barriers with concrete or provided</p>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				with sandbag as early as possible.	
COM-2010-11-160	Intake TP789	5 November 2010	The complaint was received from Kerry Property Management and advised that some complaints from the residents of Tavistock about low frequency noise generated by the power pack within Site Portion TP789.	Based on the information gathered in the investigation, the noise levels measured at near Intake TP789 were below the limit level after the Contractor implement noise mitigation measures for the noise generation activities.	Closed
COM-2010-11-160(2)	Intake TP789	9 November 2010	Some residents complained the low frequency noise after the addition of sound proof sheets on the power pack at Intake TP789.		
COM-2010-11-163	Western Portal	6 November 2010	A complaint was received from a complainant regarding noise nuisance caused by spoils dropping directly from conveyor belt into barge (rock hitting sound) at Western Portal.	Based on the information gathered in the investigation, the noise levels measured at NC3 were below the limit level.	Closed
COM-2010-11-163(2)	Western Portal	7 November 2010	A complaint was received from a complainant regarding noise nuisance caused by spoils dropping from conveyor belt into storage basin (rock hitting sound). The complainant also		

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			complained the noise of ventilation fans at the Western Portal area.		
COM-2010-11-164	Intake TP5	10 November 2010	Kerry Property Management Services received several complaints from the residents of Valverde on 10 November 2010 morning regarding working noise emitted from the Intake TP5 work site in early morning (before 7:30am).	Base on the information collected, the ad-hoc noise monitoring results measured at near Valverde was met the acceptable noise levels. Drill and blast is not considered with respect to noise annoyance, as the duration of blasting is very short and infrequent.  The Contractor volunteered to cancel late blasts and scheduling all blasts before 7pm as far as possible until the nearby adit blasting works completed by mid of December 2010 tentatively.	Closed
COM-2010-11-165	Intake TP5	15 and 17 November 2010	Kerry Property Management Ltd phoned DSD at about 17:08 hrs on 15 November 2010 relaying some complaints from the residents of Valverde about the noise/vibration due to the blasting works in past weeks. Jennifer also requested DNJV not to carry out blasting works at nights.		
COM-2010-12-170	Intake DG1	7 December 2010	The complaint was received regarding the noise arising from the excavation works, starting from 9:00 hrs, in the construction site near Evergreen Villa of Stubbs	Based on the information gathered in the Investigation, the noise levels measured at NC4 and NC6 in November and December 2010 were below the construction noise limit level or baseline levels.	Closed



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			Road.	<p>The Contractor has taken initiative to erect noise absorption blankets at the site boundary to minimize noise nuisance to the nearby residents.</p> <p>The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.</p>	
COM-2010-12-171	Intake MB16	8 December 2010	The complainant complained the works near Mount Butler Road generated dust, thus affecting the air quality in the vicinity.	DNJV would arrange water spraying at the entrance of Area B. In addition, Environmental Team and RSS would closely monitor to ensure relevant measures are effectively implemented.	Closed
COM-2010-12-173	Intake W5	14 December 2010	A complaint was received from a complainant regarding noisy construction activities at Site Portion W5 had affected her niece's study to prepare for examination.	DSD are now constructing an intake at the subject site under Hong Kong West Drainage Tunnel project. The construction work at Site Portion is expected for completion in end 2011. At the moment, the pipe piling works have been completed and the Contractor will carry out grouting work in this week and then excavation work afterwards. The noise generated by excavation works should be less than that of pipe piling	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				works. Nevertheless, DSD would closely monitor the works in order to mitigate the noise impact to the nearby residents.	
COM-2010-12-178	Intake TP5	22 December 2010	Kerry Property Management Ltd notified that some complaints from the residents regarding the early commencement of the noise works at Intake Ste TP5 (earlier than 08:00hrs) in the past few days.	As advised by DNJV on 23 December 2010, they would carry out the work at site portion TP5 from 08:00 hrs to 19:00 hrs. Eddie Yau, DNJV Public Relation Manager had already explained to Kerry about the progress and arrangement at Site Portion TP5.	Closed
COM-2010-12-179	Eastern Portal	24 December 2010	The Property Management Office of The Legend referred the complaint from the resident to DSD regarding the intermediate noise from Eastern Portal site portion in the morning and at night.	Based on the information gathered in the investigation, the noise levels measured at NC1 and NC2 were below the limit level.	Closed
COM-2011-01-181	Eastern Portal	21 January 2011	The Property Management Office of Legend called DNJV to reflect a resident's concern on early construction noise at 8:30am on Saturday.	Based on the information gathered in the investigation, the noise levels measured at NC1 and NC2 were below the limit level. The breaking work to be completed by that day.	Closed
COM-2011-02-186	Intake GL1	18 February 2011	A complaint was received from the resident of Green Lane through the ICC on 18th February 2011 about the	Based on the information gathered in the investigation, the noise levels measured at near Green Lane was marginal below the construction	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			construction noise generated from the plant equipments being operated at Intake GL1 from early in the morning and ends at around 19:00 at night.	noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact. The major noise source due to the raise boring works has been finished since 26th February 2011	
COM-2011-02-188	Western Portal	25 February 2011	The complaint was received from the resident of Bel Air who called hotline at 3am and 4pm on 25 Feb 2011 to complaint about noise. The complainant refuses to give details on the noise. He claims that he will report this to the Police and requested DNJV to provide him with copy of CNP.	Based on the information gathered in the investigation, the noise levels measured at NC3 was below the limit level.	Closed
COM-2011-03-189	Western Portal	7 March 2011	Property management office of Aigburth and Valverde transferred noise complaints of residents about the vibration and early working noise emitting from the TP5 and TP789. DNJV replied to explain to the PMO.	DNJV had already explained to Property management office of Aigburth and Valverde about the progress and arrangement at Site Portion TP5. The raise boring work to be completed by that day.	Closed
COM-2011-03-190	Western Portal	7 March 2011	The complaint was received from the resident of Aegean	Based on the information gathered in the investigation, the noise levels	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-03-193 (1)	Western Portal	14 March 2011	Terrace who complained about the night-time noise of Western Portal. DNJV would review the works during the restricted hours and further improve the enclosure where necessary.	measured at Western Portal was below the construction noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact.	
COM-2011-03-193 (2)	Western Portal	16 March 2011			
COM-2011-03-192	Intake B2	14 March 2011	The PMO of Grand House at Macdonnell Road complained about the construction noise at the intake B2. In the site portion, rock excavation works was being carried out. The works was anticipated to complete in end April 2011.	Based on the information gathered in the investigation, the noise levels measured at near B2 was marginal below the construction noise limit. The Contractor has taken initiative to enclose the hydraulic breaker with noise absorption blankets to minimize noise nuisance to the nearby residents. The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.	Closed
COM-2011-03-195	Intake CR1	28 March 2011	The complaint was received from the resident of Conduit Tower, who complained about the construction noise at the intake CR1.	Based on the information gathered in the investigation, the noise levels measured at near CR1 was well below the construction noise limit. The Contractor has taken initiative to erect noise absorption blankets at the whole site boundary to minimize noise nuisance to the nearby residents.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.</p>	
COM-2011-05-210	Intake GL1	30 May 2011	<p>The complaint was raised from the resident of Green Lane, who complained about the construction noise at the intake GL1.</p>	<p>Based on the information gathered in the investigation, the noise levels measured at near Green Lane was well below the construction noise limit.                      However, the Contractor has already implemented the noise mitigation measures to reduce noise impact.</p>	Closed
COM-2011-05-211	Intake CR1	30 May 2011	<p>The complaint was received from the resident of Conduit Tower, who complained about the construction noise at the intake CR1. The complainant mainly concerned that the noisy works at Intake CR1 started at 8:00 hrs everyday is too early. He requested to defer the working hours later.</p>	<p>Based on the information gathered in the investigation, the noise levels measured at near CR1 was well below the construction noise limit.                      The Contractor has taken initiative to erect noise absorption blankets at the whole site boundary to minimize noise nuisance to the nearby residents.                      The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.</p>	Closed

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
COM-2011-06-214	Intake P5	2 June 2011	The public complaint was raised on 2 <sup>nd</sup> June 2011 via Environmental Protection Department (EPD) regarding the construction noise nuisance from the Hong Kong West Drainage Tunnel construction site at Intake P5.	Based on the information gathered in the investigation, the noise levels measured at near P5 was well below the construction noise limit. In addition, the pipe-piling work has been stopped until the end of July 2011. However, the Contractor has prepared the remedial action that should be taken while starting the pipe-piling work. The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.	Closed
COM-2011-07-218	Western Portal	2 July 2011	A public complaint was received from the resident of Aegean Terrace on 2nd July 2011 regarding the construction noise nuisance from the Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site) near Aegean Terrace.	Based on the information gathered in the investigation, the noise levels measured at Western Portal was below the construction noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-07-219	Intake P5	8 July 2011	A public complaint was received from the resident of Belmont Court on 8th July 2011 and suspected in relation to the construction noise nuisance from the Hong Kong West Drainage Tunnel construction site at Intake P5.	Based on the information gathered in the investigation, the noise levels measured at near P5 was well below the construction noise limit. In addition, the pipe-piling work has been stopped until the end of July 2011. However, the Contractor has prepared the remedial action that should be taken while starting the pipe-piling work.	Closed
COM-2011-07-225	Intake PFLR1	27 July 2011	A resident, lives near Intake PFLR1, called DSD complaining the noise generated from the RBM. The noise probably generated from the RBM drilling rig.	Based on the information gathered in the investigation, the noise levels measured at near PFLR1 was below the construction noise limit. In addition, the Contractor has taken initiative to enclose or wrap the noise source with sound insulating materials to minimize noise nuisance to the nearby residents.	Closed
COM-2011-07-227	Intake CR1	30 July 2011	A resident complained about the noise from the Site Portion CR1. She said it was not supposed to work on Saturdays.	DNJV responded that the working hours are from Mondays to Saturdays. Currently, pipe piling works were in progress. They would improve the mitigation measure. According to the noise level measured at podium of Conduit Tower starting at 10:09 hrs on 1 August 2011, it was 73.5 dB(A). The works was completed at 9:10 hrs on 2 August 2011.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-07-228	Eastern Portal	29 July 2011	<p>The complaint was lodged by a complainant who referred some residents' complaints about the dust and smoke generated from Eastern Portal tunneling works recently. He urged to implement an effective and protective mitigation measures as soon as possible.</p>	<p>Both the 1-hour and 24-hour TSP monitoring results in July 2011 showed dust levels at True Light Secondary School were under Action and Limit Levels.</p> <p>The potential sources of smoke or dust may be occasionally generated at the Eastern Portal as a result of the difference in atmospheric condition such as temperature and humidity inside and outside the tunnel. This is a normal atmospheric phenomenon and did not constitute to environmental impacts.</p> <p>There are sufficient measures to minimize the smoke or dust emission, such as sprinkle system inside adits under blasting works. There was no deficiency recorded in the Eastern Portal.</p> <p>Ventilation system inside the tunnel was designed to extract the blasting fume from adits towards the adit dust scrubber in the Western Portal and then discharged locally. There should not be blasting fume accumulated in the Eastern Portal with a normal ventilation system.</p>	Closed



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-08-229	W0	9 August 2011	A resident complained about noise generated from DSD works area in the park on 24 Stubbs Road. The works caused obstruction to pedestrians and affected the environment. The complainant requested to obtain the contact of responsible person of the works.	Based on the information gathered in the investigation, the noise levels measured at the Hong Kong Academy was below the construction noise limit. According to the regular weekly site inspections in July and August 2011, there was no major noisy activity to be conducted at Intake W0. However, the Contractor has taken initiative to minimize noise nuisance to the nearby residents by implementation of mitigation measures before the time of complaint.	Closed
COM-2011-08-230	EP	11 August 2011	A resident complained about the noise generated from rock breaking works at Eastern Portal during past few weeks. The complainant said that the noise was deafening and the breaking works was continuously carried out from 08:00 hrs to 18:00 hrs without consider the feeling of residents living nearby. It caused great nuisance to them.	Based on the information gathered in the investigation, the noise levels measured at the Legend was below the construction noise limit. However, the work was temporarily ceased after the complaint case emerged. To alleviate the breaking noise, the contractor plans to implement mitigation measures as far as practical. They may include wrapping the breaking head, erecting noise barriers or blankets, and controlling breaking duration.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-08-232	W10	24 August 2011	A complainant said that noise came out from our Site Portion W10 near junction between Kotewall Road and University Drive, i.e. Intake W10 around 7:00 am on 19 August 2011 and requested us to keep the noise down in the early morning.	The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. All noisy activities, the start of machine including Raise Boring Machine or other supporting plants/equipments would only be started after 08:00hrs; 2. Only non-noisy activities i.e. site safety briefing, body stretching exercise etc. could be carried out within the Site Portion before 08:00hrs.	Closed
COM-2011-08-233	P5	25 August 2011	A resident complained that the noise generated from the Site Portion at the junction of Kotewall Road and Robinson Road caused immense nuisance.	Based on the information gathered in the investigation, the noise levels measured at the Legend was below the construction noise limit. The Contractor undertook some measures to alleviate the noise emission, as observed during site inspections. After receiving the complaint, the Contractor further reinforced the noise reduction measures that include extending noise barriers into a direction facing toward Villa Veneto, installing noise blankets at the piling rig curtain.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				<p>In addition, the Contractor controlled the piling duration in order to minimize a continuous and persistent emission of piling noise.</p> <p>In early September, it was observed in site inspections that a large scale of building innovation work started in Villa Veneto. Continuous breaking noise from the innovation work imposed difficulties to justify noise sources and it may induce complaints from the general public.</p>	
COM-2011-08-234	BR5	26 August 2011	<p>The complainant is from the PMO of Camelot Height (金巒閣) on Kennedy Road (near Site Portion BR5). He said that construction noise, generated from the work site on the slope at the back of their building, was heard at about 07:30 hrs recently. It caused great nuisance to residents.</p>	<p>The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect:</p> <ol style="list-style-type: none"> <li>1. All noisy activities, the start of machine including Raise Boring Machine or other supporting plants/equipments would only be started after 08:00hrs;</li> <li>2. Only non-noisy activities i.e. site safety briefing, body stretching exercise etc. could be carried out within the Site Portion before 08:00hrs.</li> </ol>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-09-239	MA14	28 September 2011	A resident from PMO of Harbour View complained about the construction works of Site Portion MA14 near Magazine Gap Road started before 7:00hrs on 28 September 2011. The noise generated by the construction plants i.e. RBM was annoying. He requested to keep the noise down in the early morning.	The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. All noisy activities, the start of machine including Raise Boring Machine or other supporting plants/equipments would only be started after 08:00hrs; 2. Only non-noisy activities i.e. site safety briefing, body stretching exercise etc. could be carried out within the Site Portion before 08:00hrs.	Closed
COM-2011-10-240	M3	23 October 2011	A resident complained that the noisy drilling works were carried out at our Site Portion M3 near May Road on Sunday. At the time of the complaint, there are two workers of a subcontractor who entered into the M3 working area at about 2pm, without notifying the Contractor. The workers started excavating the bottom of the drop-shaft manually.	The Contractor is well aware of the related regulations about using powered mechanical plants in restricted hours. The Contractor was maintaining a close communication with all sub-contractors working in this Project. There was no previous case happened in other subcontractors and therefore it was believed that it was a discrete incident. The incident was attributed to the workers' ignorance of such regulations. The Contractor delivered an additional relevant training to	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
				brief the sub-contractor soon after the incident. It was re-iterated in the training that the subcontractor and his workers should strictly adhere to the related regulations, and they should obtain approval from the Contractor in advance to carry out works during restricted hours.	
COM-2011-11-242	EP	16 November 2011	A resident complained about the noise at night around 9pm to 10pm in his premises at Ronsdale Garden. In addition, noisy construction has been carried out near Ronsdale Garden during the daytime recently.	The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: <ol style="list-style-type: none"> <li>1. Rock breaking works due to the removal of temporary decking, structure and the river dam would be carried out intermittently.</li> <li>2. RSS and the Contractor would regularly check the stream condition to prevent mosquito breeding,</li> <li>3. The Contractor was reminded to expedite the works and implement noise mitigation measures as far as practicable.</li> </ol>	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2011-11-243	BR6	22 November 2011	A resident at Ewan Court complained that a big noise, which should be generated by blasting works at intake BR6, was heard at about 13:49 at the day of complain. Some other residents heard similar “bang” noise last week at 6pm to 9pm.	The complainant was advised that two blasts per day were in progress at adit BR6. The Contractor will take the following follow-up measures: 1. Only one blast per day would be conducted starting on 28 November 2011 2. RSS would closely monitor the whole blasting process	Closed
COM-2011-11-244	DG1	24 November 2011	A resident at Villa Monte Rosa was annoyed by the noise generated from intake DG1 for couple of days. She asked when such noisy works would be completed. The resident added that more mosquitoes had been found recently and asked if the Contractor would take any measures against mosquito breeding.	The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. The breaker head was wrapped by noise absorptive materials 2. Sound proof sheet would be erected on the side facing Villa Monte Rosa 3. Mosquito oil would also be sprayed on the afternoon of 24 November 2011	Closed
COM-2011-11-245	TP5	24 November 2011	A resident nearby would like to know the completion date of intakes on May Road. He complained about that such works started making noise at around 8:20am and questioned if such works got	The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. Sound proof insulation sheet has been installed to remediate the	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
			the permission to start as early as 8pm in the morning.	noise nuisance generated by the rock breaking works during the removal of the temporary structure 2. Noisy works would be carried out starting at 9am instead of 8am 3. RSS would closely monitor the site condition	
COM-2011-11-247	HKU1	17 November 2011	A professor at the University of Hong Kong complained about the percussive drilling noise generated from intake HKU1. The works started on 16 November at about 1pm. He requested to take steps to halt the severe noise.	Noise enclosure with Sound proof sheet was erected on 23 November 2011.	Closed
COM-2011-12-248	EP	1 December 2011	A resident from Ronsdale Garden complained about the noise nuisance at Eastern Portal	The drill of the breaker was wrapped up by noise absorptive materials. Sound proof sheets were erected on 5 December 2011 to further mitigate the noise. Regular noise monitoring would be conducted.	Closed

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
COM-2011-12-249	EP	12 December 2011	The complainant complained that water was found flowing onto carriageway and pedestrian from Eastern Portal.	The drainage system at EP has been cleaned up and cleaning frequency would be increased when necessary. All drivers were reminded to wash their vehicles' wheels within EP compound.	Closed
COM-2011-12-252	EP	17 December 2011	The Project Management Office of The Legend referred a resident's complaint about noise generated from Eastern Portal at about 7am.	The complainant was advised on the same day at 11:30am that all noisy construction works would only be carried out after 8:30am from Monday to Saturday starting from 17 Dec 2011.	Closed
COM-2011-12-255	EP	21 December 2011	The residents near Eastern Portal concerned about that the noise generated has recently become more severe, and the works started at around 8am which seems to be too early.	The noisy works will be carried out intermittently and would not be carried out before 8:30am. The Contractor is also studying the possibility of the use of chemical explosives instead mechanical breaking.	Closed
COM-2011-12-256	EP	29 December 2011	A resident of The Legend complained about the noise generated from Eastern Portal starting from 28 Dec 2011, and enquired about the completion date of all noisy works.	The complainant was advised on the same day at 1pm that the noisiest works would be completed before Chinese New Year and all construction works were scheduled for completion in mid 2012. He was also assured that all noisy works would be carried out intermittently to mitigate the noise nuisance to the nearby residents.	Closed



Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2012-01-257	EP	31 December 2011	The complainant complained about the noise nuisance to the residents nearby at Eastern Portal.	The complainant was advised that the Contractor has already implemented noise mitigation measures such as wrapping the breaker head and erecting the sound proof sheets. The Contractor is also studying the possibility of the use of chemical explosives instead mechanical breaking.	Closed
COM-2012-01-258	EP	9 January 2012	A resident near Eastern Portal complained about the noise generated from the site at about 8:15-8:20 am, and enquired when the construction works would be completed.	The complainant was assured that such work would not be carried out before 8:30 am and was told that the project would be completed mid-2012. She was also informed that the Contractor has erected sound proof sheets and been considering using alternative method to minimize noise.	Closed
COM-2012-01-263	EP	16 January 2012	The resident heard a non-stop pumping sound on 14 January night at 2.15 am. Although he closed all doors and windows, he still heard the regular 'bump bump bump' humming sound.	The complainant was advised that the 'bump bump' sound might be generated by the water pump within the site portion. She was informed that the pump will be switched off between 7pm to 7am of the next day to minimize the noise nuisance. The situation would be monitored closely by both RSS and the Contractor.	Closed

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
COM-2012-01-267	EP	27 January 2012	A resident at the Legend complained about noise generated from Eastern Portal, which started from 7am until 5 or 6pm every day. The complainant also enquired about when the construction works would be completed.	She was assured that breaking works would not be started before 8am everyday and the Contractor would adopt the revised breaking method.	Closed
COM-2012-02-268	EP	3 February 2012	The complainant complained about a “woo woo” noise at 11pm on 2 Feb night. He suspected that the noise was generated from the electric motor at Eastern Portal and requested the Contractor to switch it off at night.	The complainant was advised that no works were carried out at night on 2 Feb. Moreover the water pump and all construction plants had been switched off. He was assured that the Contractor would closely monitor the situation.	Closed
COM-2012-02-273	PFLR1	6 February 2012	The complainant complained about the noise generated from intake PFLR1 inside Pokfulam Playground.	The complainant could not be reached at phone on three trials from 6-8 Feb.	Closed

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
COM-2012-02-276	W8	13 February 2012	The complainant complained about the noise generated from construction works at intake W8 starting as early as 8am. He also enquired the completion date of works of the project.	The existing water pump has been installed with additional cover. The shaft opening has been covered by sound proof sheets. Additional noise panel was also constructed to screen the noise to be emitted to the neighbouring residential areas.	Closed
COM-2012-02-278	W8	17 February 2012	Residents at 80 Robinson Road complained about a continuous low frequency “woo woo” noise between 10pm to 4 am at midnight. Later, the “woo woo” sound was also heard on 18 Feb and on 20, 22 Feb during daytime.	On-site investigation was carried out by the Contractor and the RSS. Construction plants and activities were requested to stop to verify the noise. It was concluded that the noise was not generated from our construction site.	Closed
COM-2012-02-282	BR6	27 February 2012	Some members of Incorporated Owners of Ewan Court complained about a continuous noise (like from a running machine) from the construction site all over the night.	The complainant was advised that during night time, mainly adit lining works was performed and such work is scheduled to be completed in early May 2012. The opening of the dropshaft has also been covered by sound proof sheets to act as a noise barrier.	Closed

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
COM-2012-03-284	W8	5 March 2012	Residents at 80 Robinson Road complained about the mechanical noise nuisance in 24 hours from Intake W8.	Referring to the on-site investigations in February 2012, it was concluded that the continuous low frequency noise was not generated from our construction site. In addition, there was no heavy mechanical means in our construction site generating such noise. The complainants again agreed with the advice.	Closed
COM-2012-03-289	M3	26 March 2012	The complainant complained about the noise generated from the construction site on Saturday 24 March 2012.	The complainant was advised that the noise was generated by removal of concrete head wall at intake M3. To minimize noise nuisance, the Contractor has deferred to start the noisy work at 8:30 am every day. The removal works had been completed on 27 March 2012.	Closed
COM-2012-04-294	MA17	13 April 2012	The complainant complained about the noise generated from construction works at intake MA17 at 7 am.	The complainant was advised that works in progress at intake MA17 did not cause much noise. She was also assured that noisy works at intake MA17 would only be started after 8 am.	Closed

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
COM-2012-05-298	Western Portal	1 May 2012	The complainant complained about the recent noise generated from Western Portal at midnight until 4am.	From investigation, Concreting works was carried out at night at Western Portal until 9pm but no construction works was carried out at Western Portal at midnight.	Closed
COM-2012-05-305	Eastern Portal	14 May 2012	The DC member of Wan Chai has recently received complaints from residents near Eastern Portal about the noise generated from the site.	Upon receipt of the complaint, the noisy rock-splitting works was temporarily stopped. The Contractor has wrapped up the breaker and carried out the noisy works intermittently.	Closed
COM-2012-06-311	Eastern Portal	4 June 2012	A resident of the Legend complained about the low frequency noise generated from Eastern Portal. She also felt the vibration in her flat whole night, which caused great nuisance.	The Contractor has relocated the generator, which is believed to be the source of noise. The complainant was contacted again and said the noise has stopped at 7pm of the same night.	Closed

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
COM-2012-06-312	Eastern Portal	4 June 2012	The PMO of the Legend referred the complaints from their residents about the low frequency noise generated at Eastern Portal starting from 2 June 2012 at midnight.	The complainant was advised that all works were only carried out inside tunnel at night at the time of complaint. He was contacted again on 5 June 2012 and mentioned that no noise was heard on 4 June 2012 midnight.	Closed
COM-2012-06-313	Western Portal	2 June 2012	A resident at Aegean Terrace complained about the noise nuisance at day time.	The complainant was advised that all the noisy construction activities within Western Portal will be completed in late June 2012.	Closed
COM-2012-06-316	Eastern Portal	18 June 2012	The DC Member of Wan Chai District referred a resident from the Legend, who complained about the low frequency “wuung” engine noise generated from Eastern Portal throughout the day.	The complainant has been advised that the old generator has been replaced by a new one. The generator would only be switched on before 7:45am and after 7pm every day.	Closed

---


---

**APPENDIX L  
GRAPHICAL PRESENTATION OF  
WATER QUALITY MONITORING  
RESULTS**

---

---


## Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

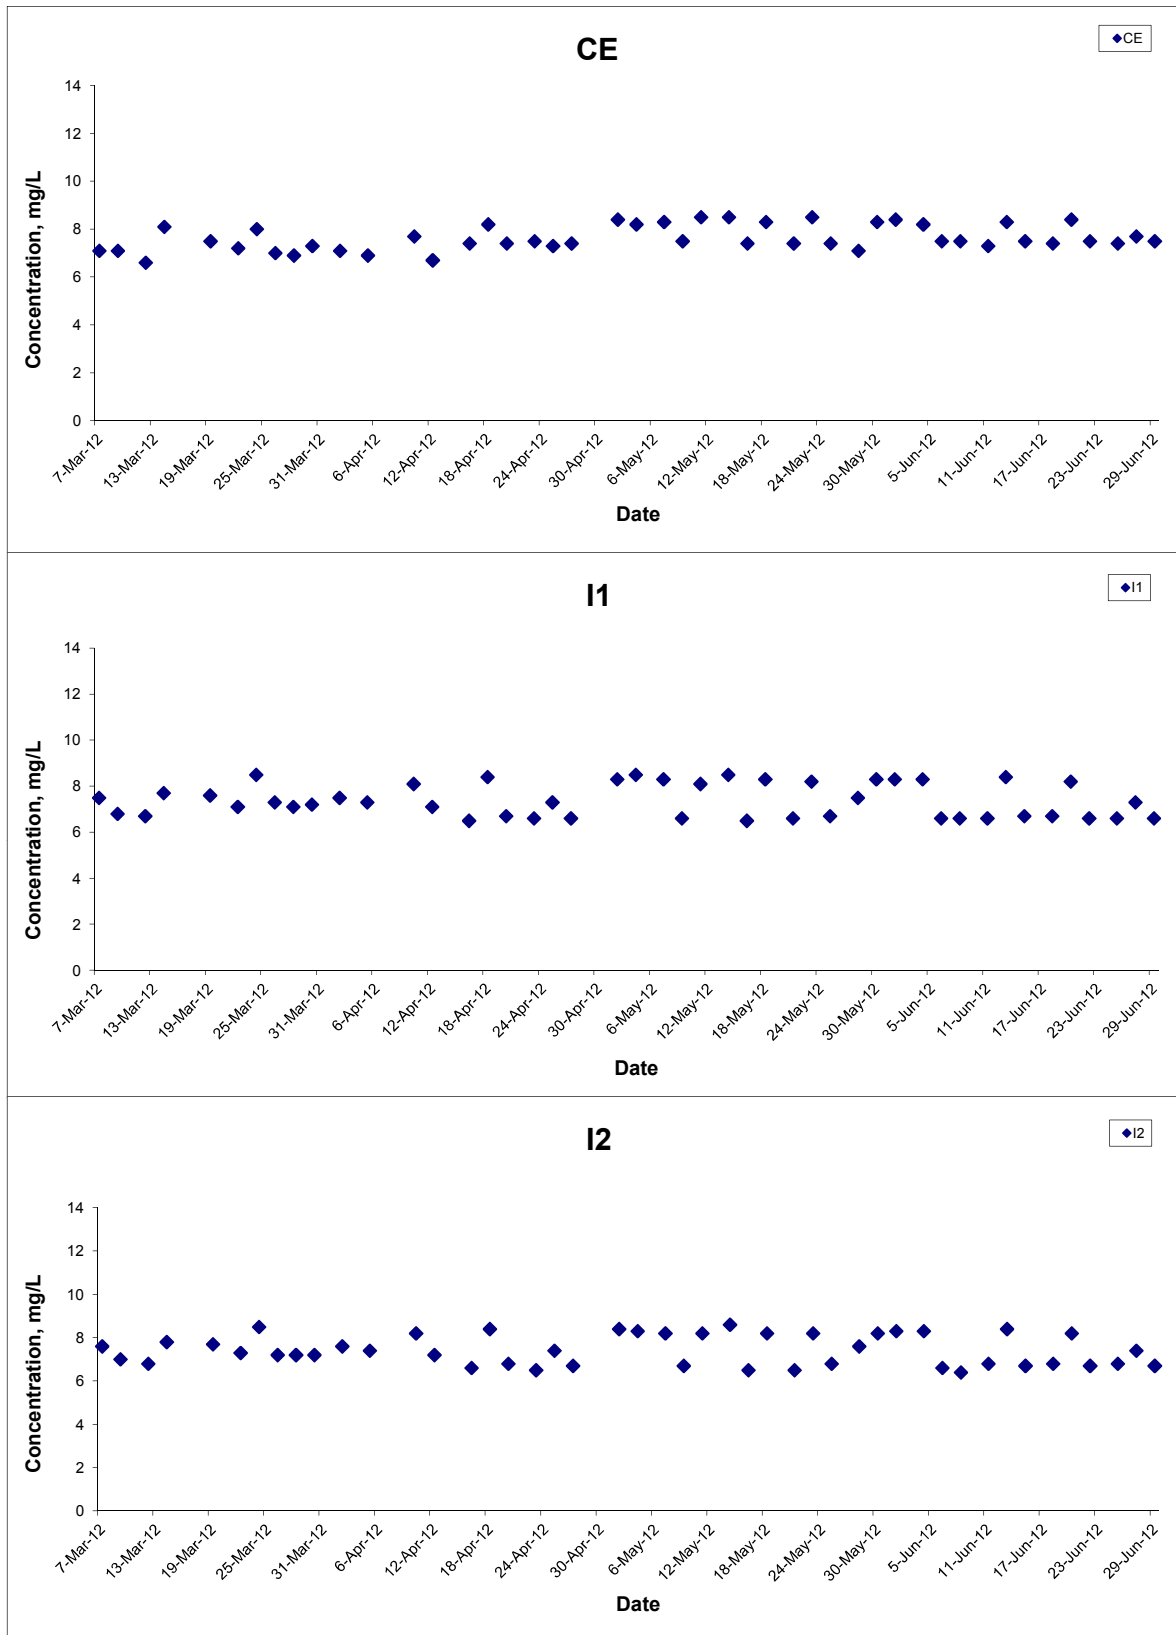

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale	N.T.S	Project No. MA8001	CINOTECH
	Date	Jun 12	Appendix L	




## Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

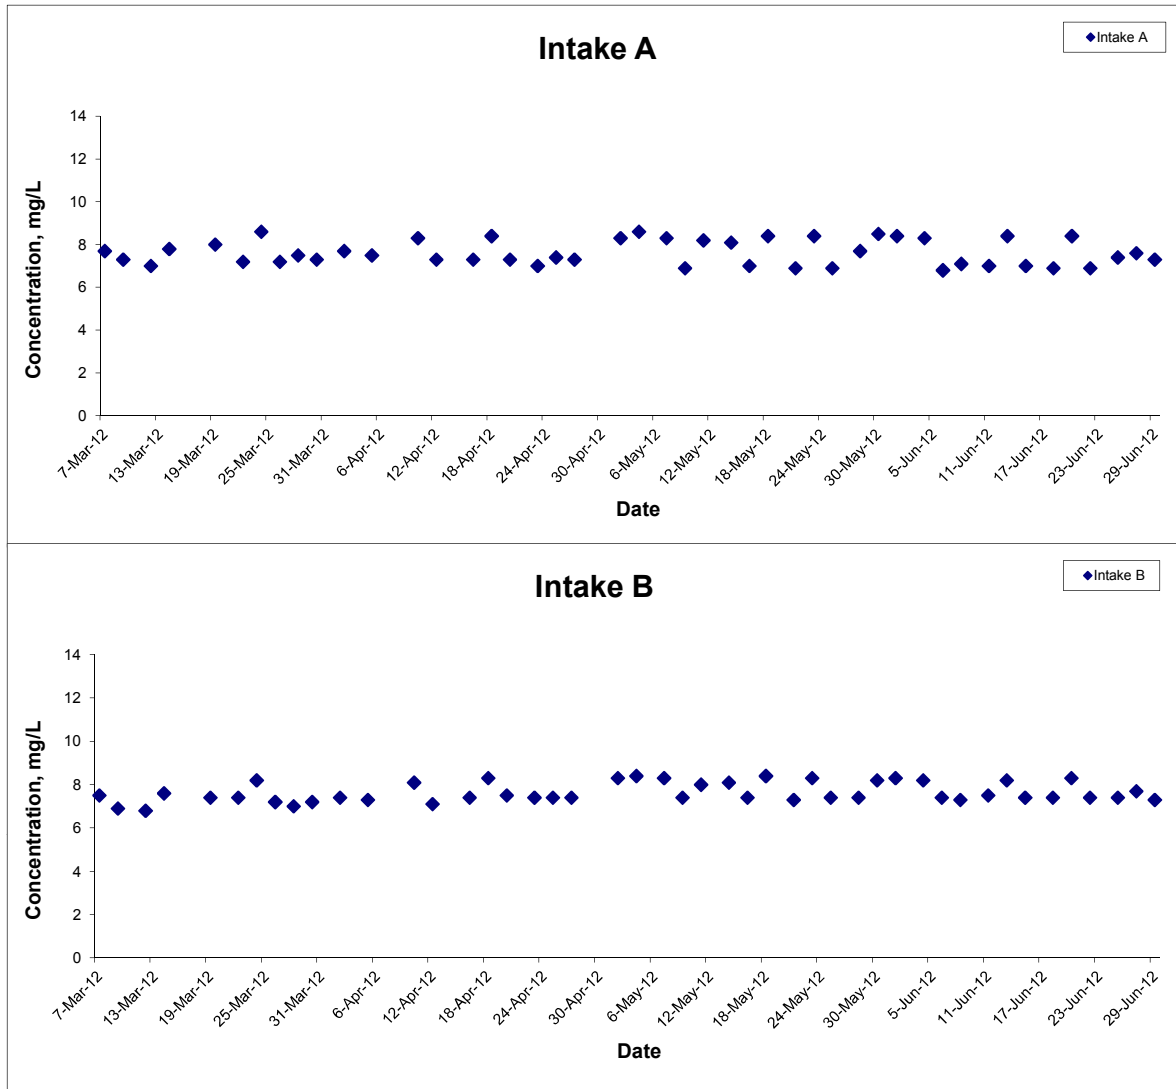


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix L	

## Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

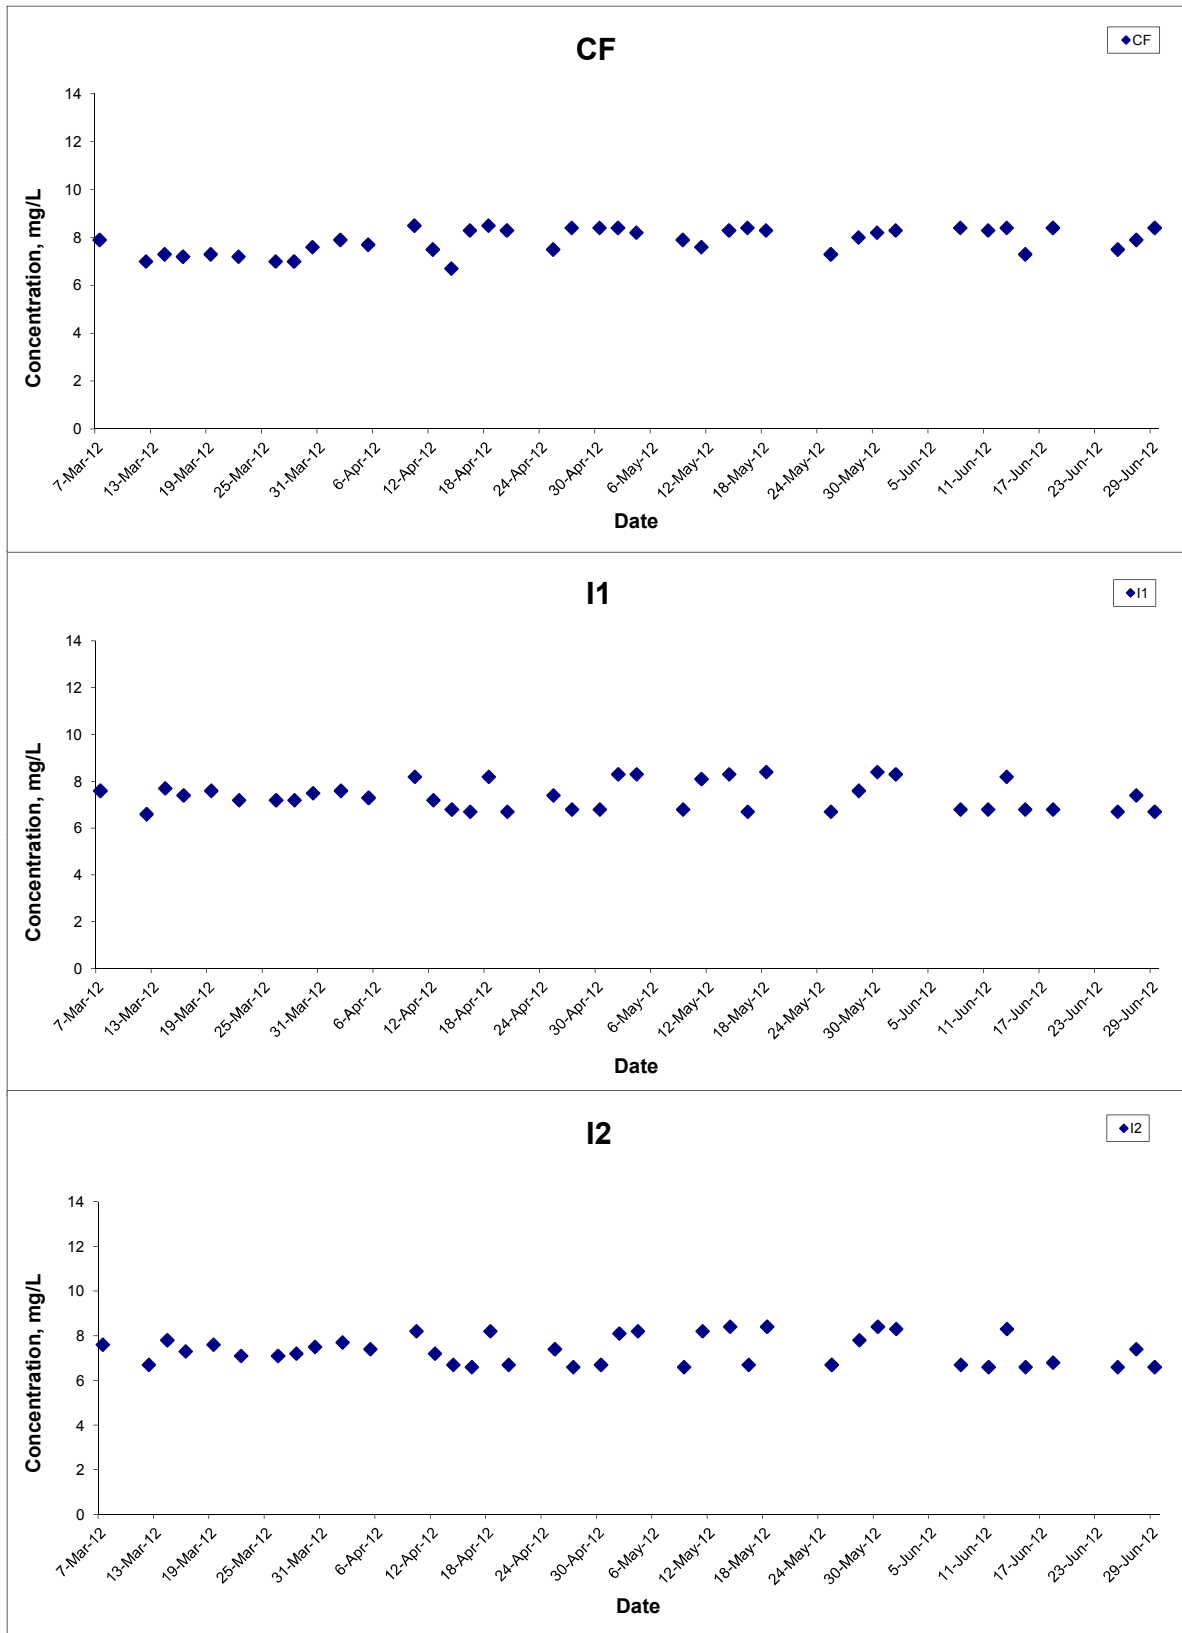


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	
	Date Jun 12	Appendix L	

## Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

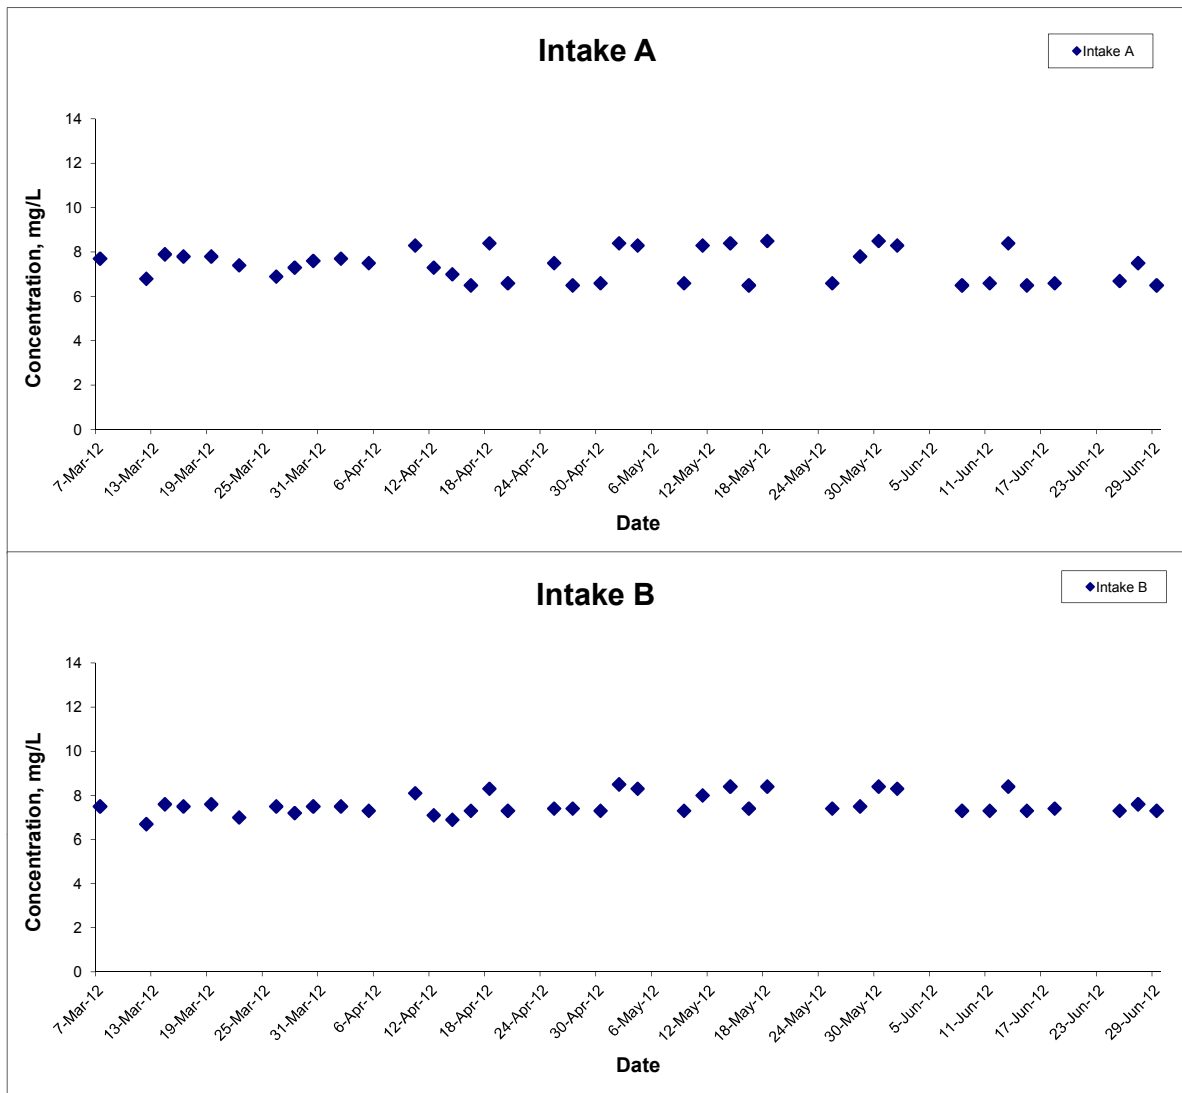


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix L	

## Dissolved Oxygen (Bottom) at Mid-Ebb Tide

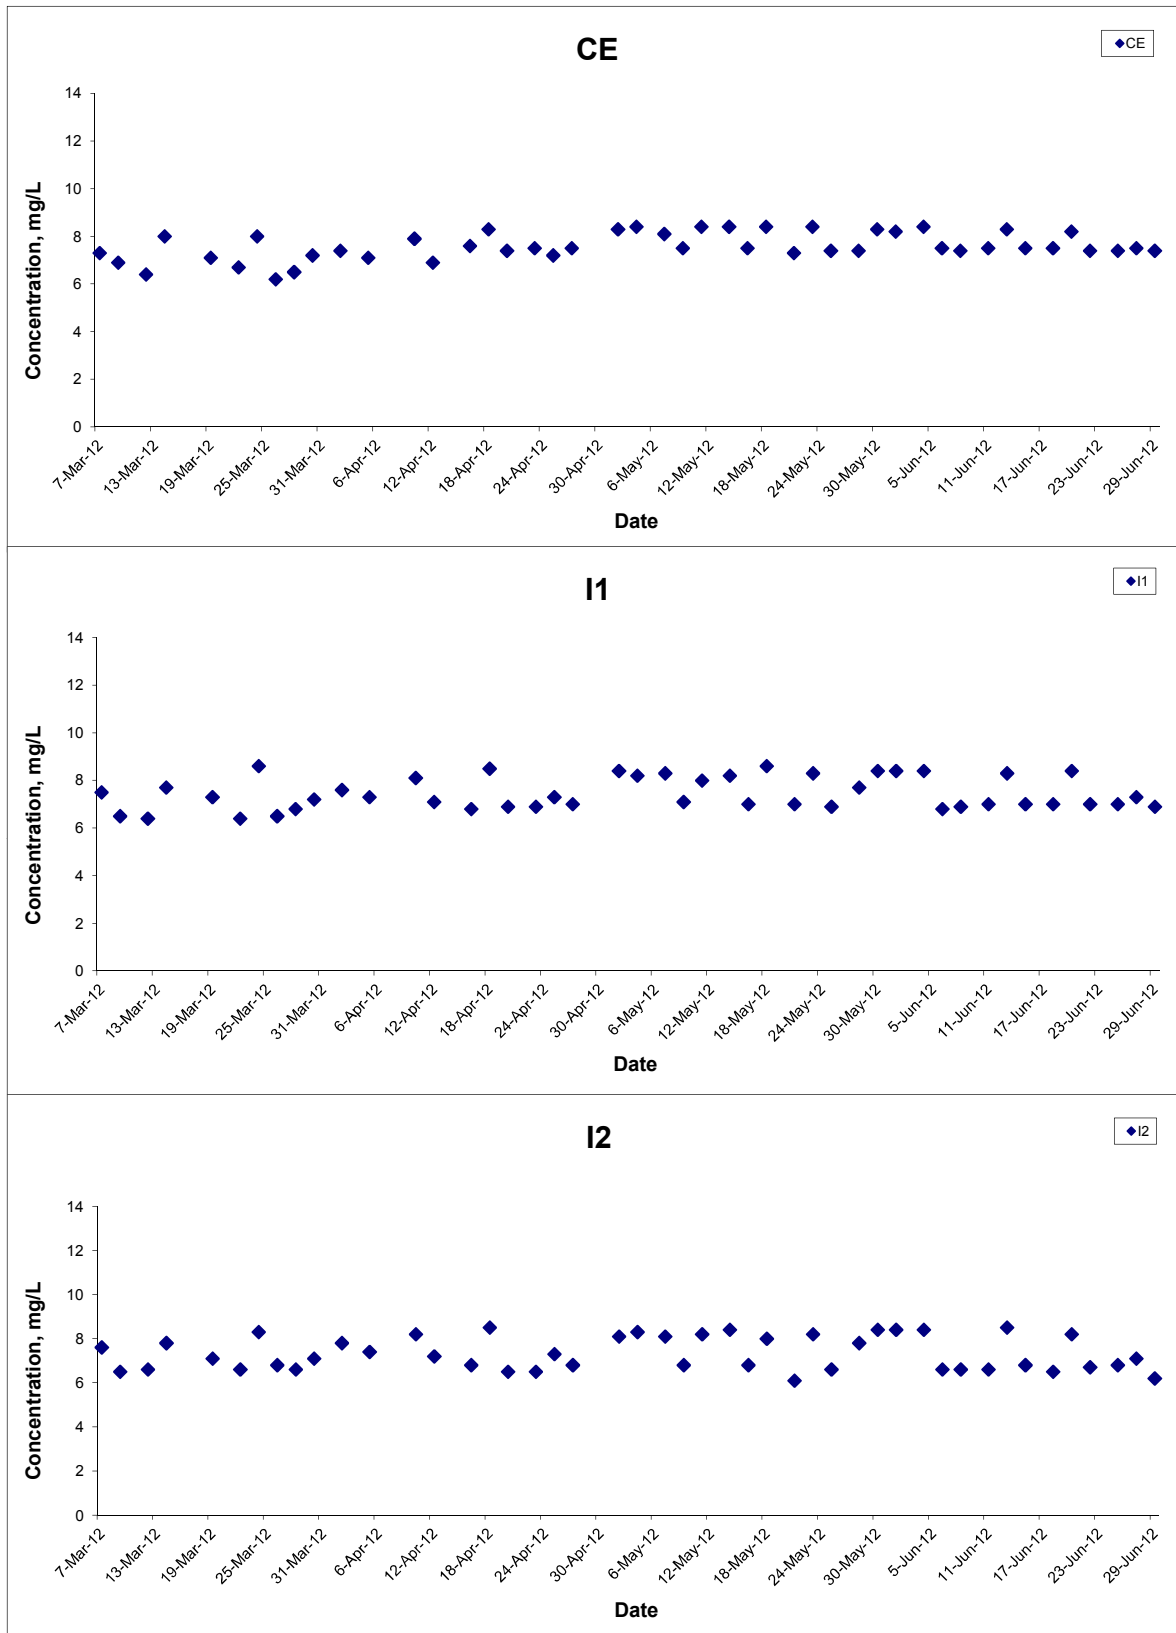


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix L	

## Dissolved Oxygen (Bottom) at Mid-Ebb Tide

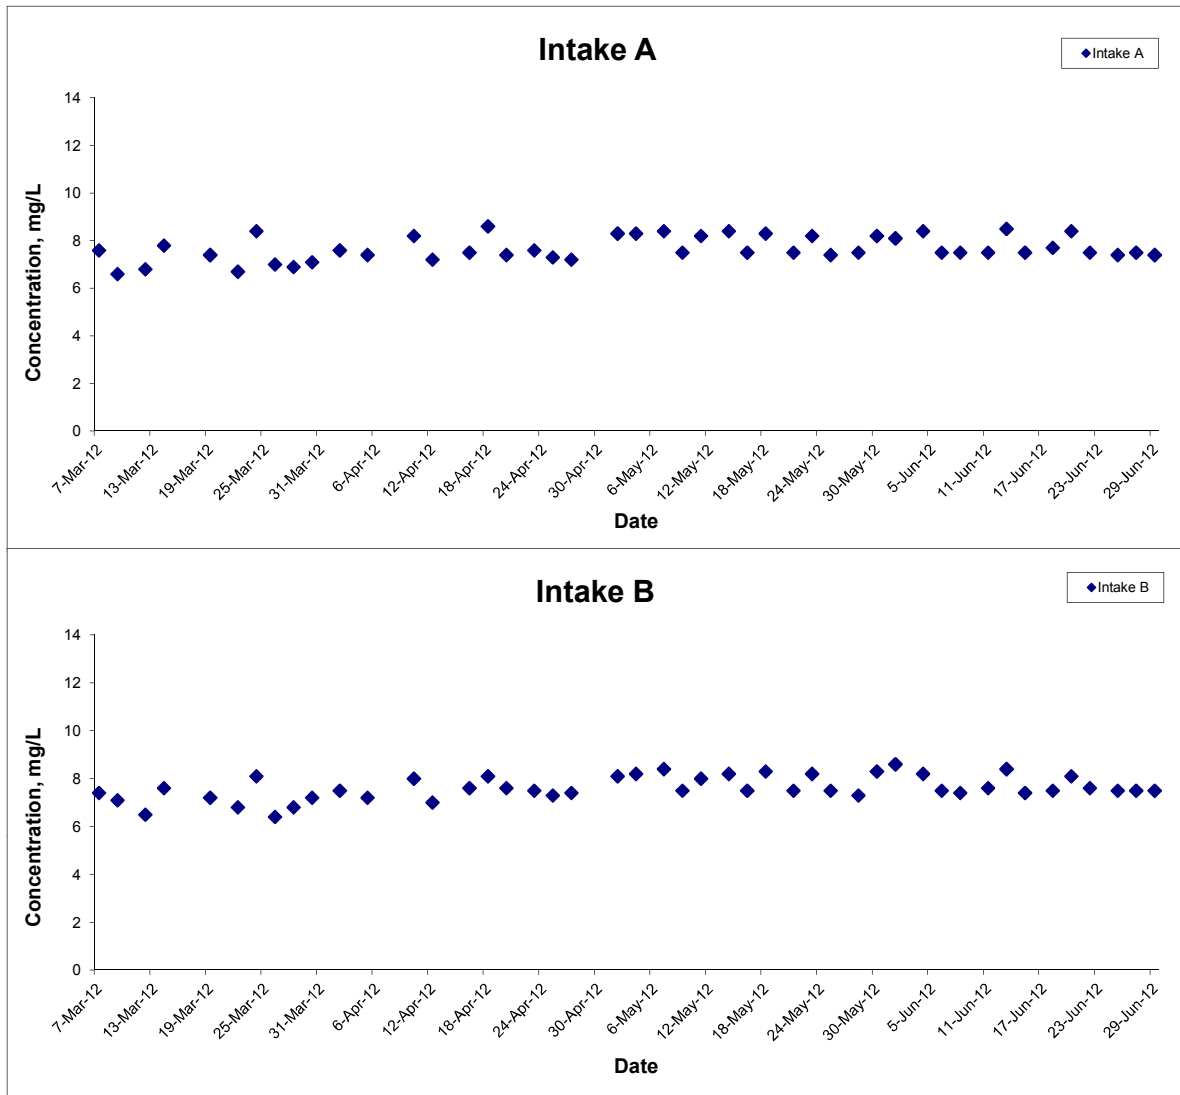


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	
	Date Jun 12	Appendix L	

## Dissolved Oxygen (Bottom) at Mid-Flood Tide

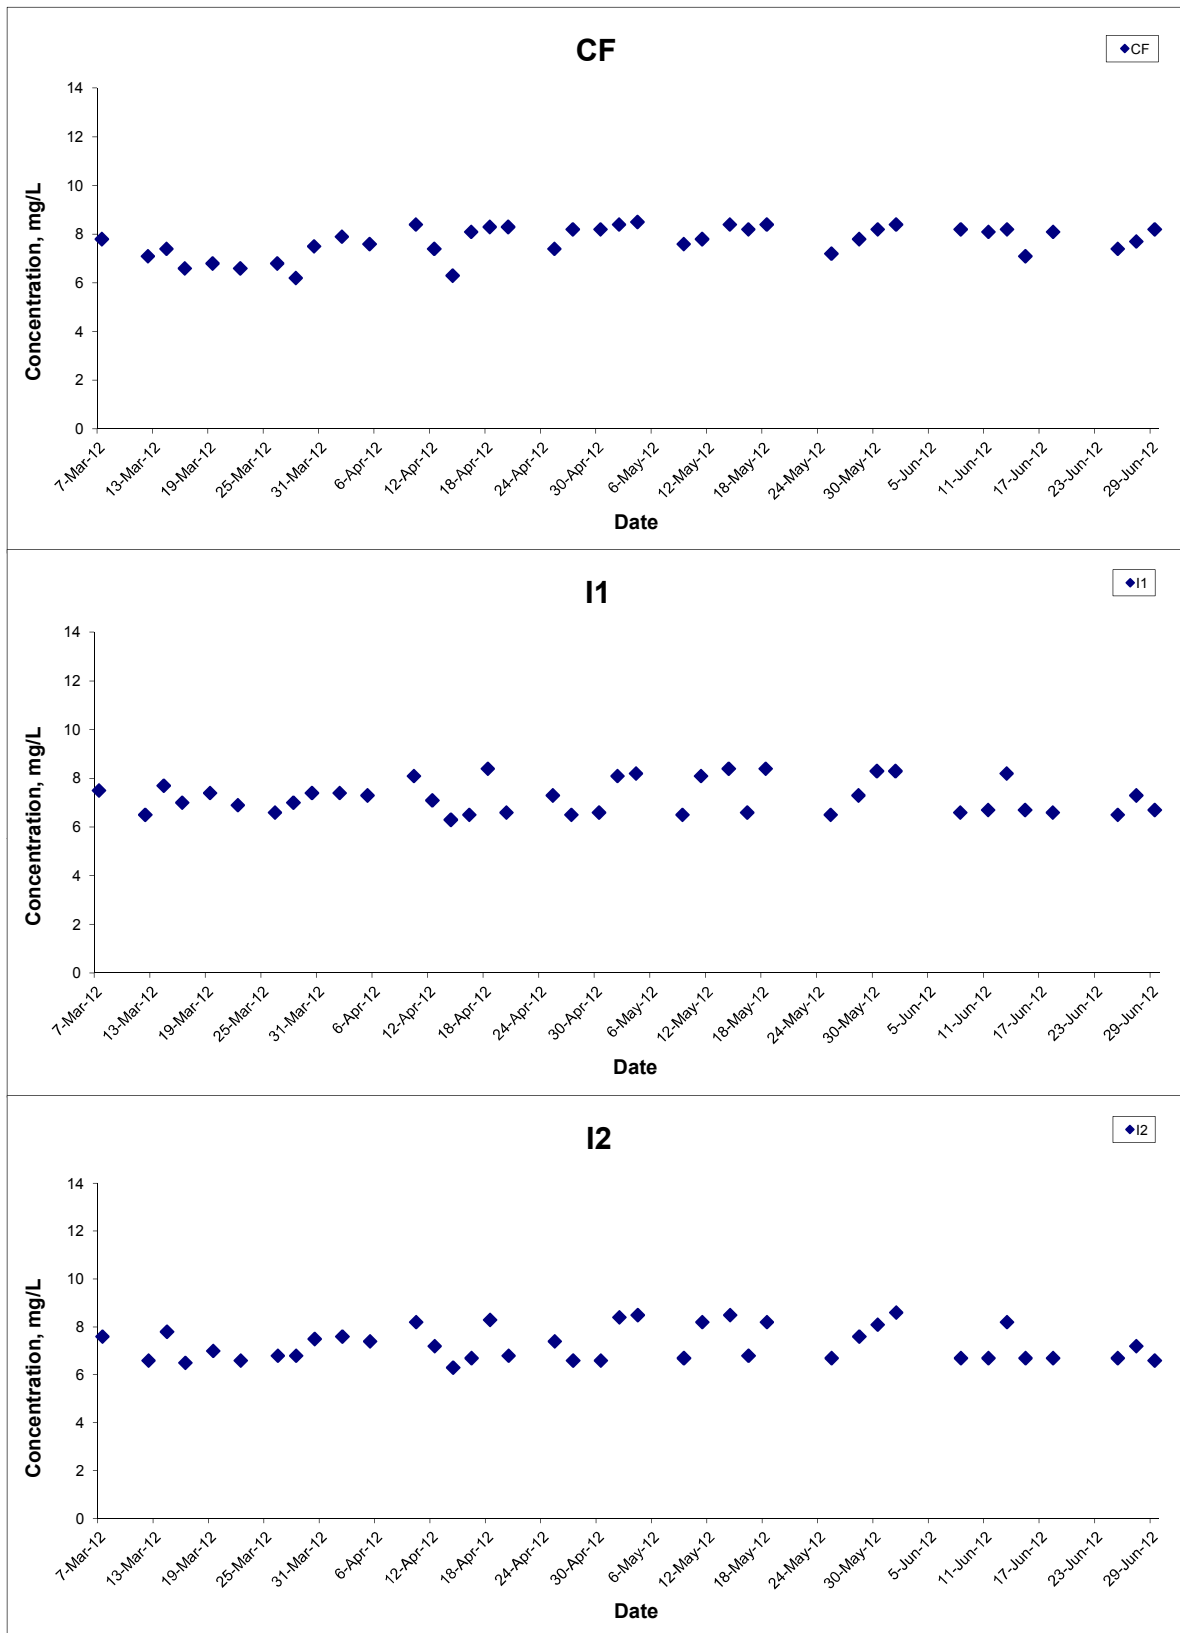


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix L	

## Dissolved Oxygen (Bottom) at Mid-Flood Tide

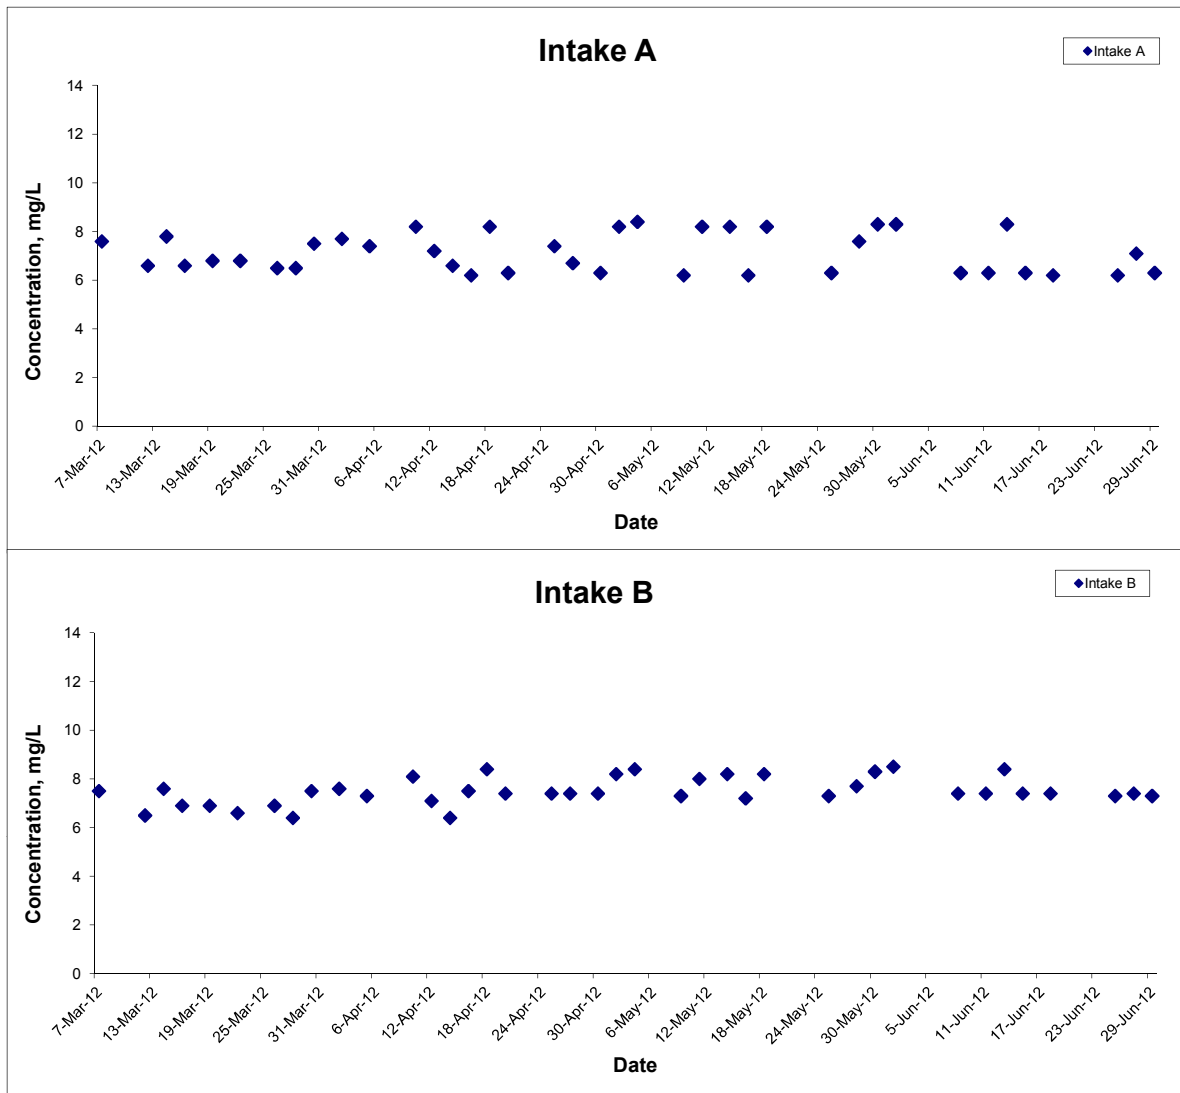

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	<b>CINOTECH</b>
	Date Jun 12	Appendix L	


## Turbidity (Depth-averaged) at Mid-Ebb Tide

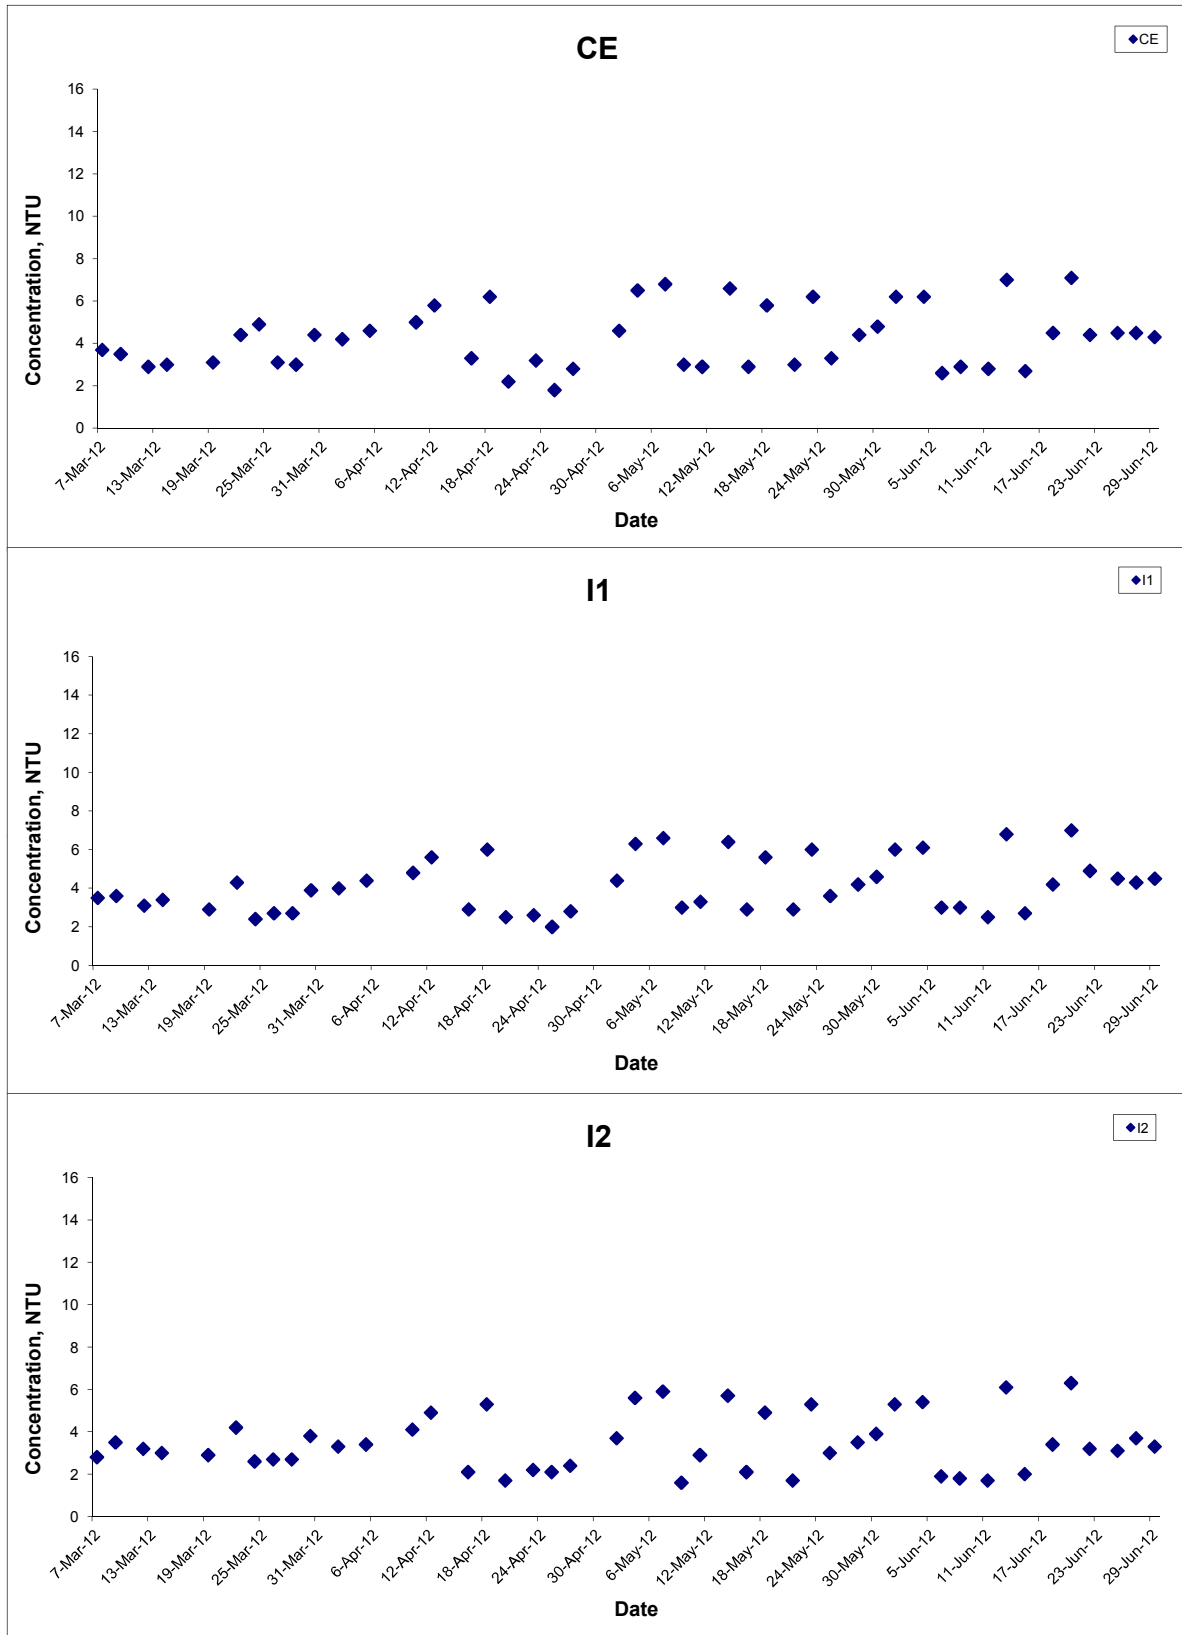

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix L	




## Turbidity (Depth-averaged) at Mid-Ebb Tide

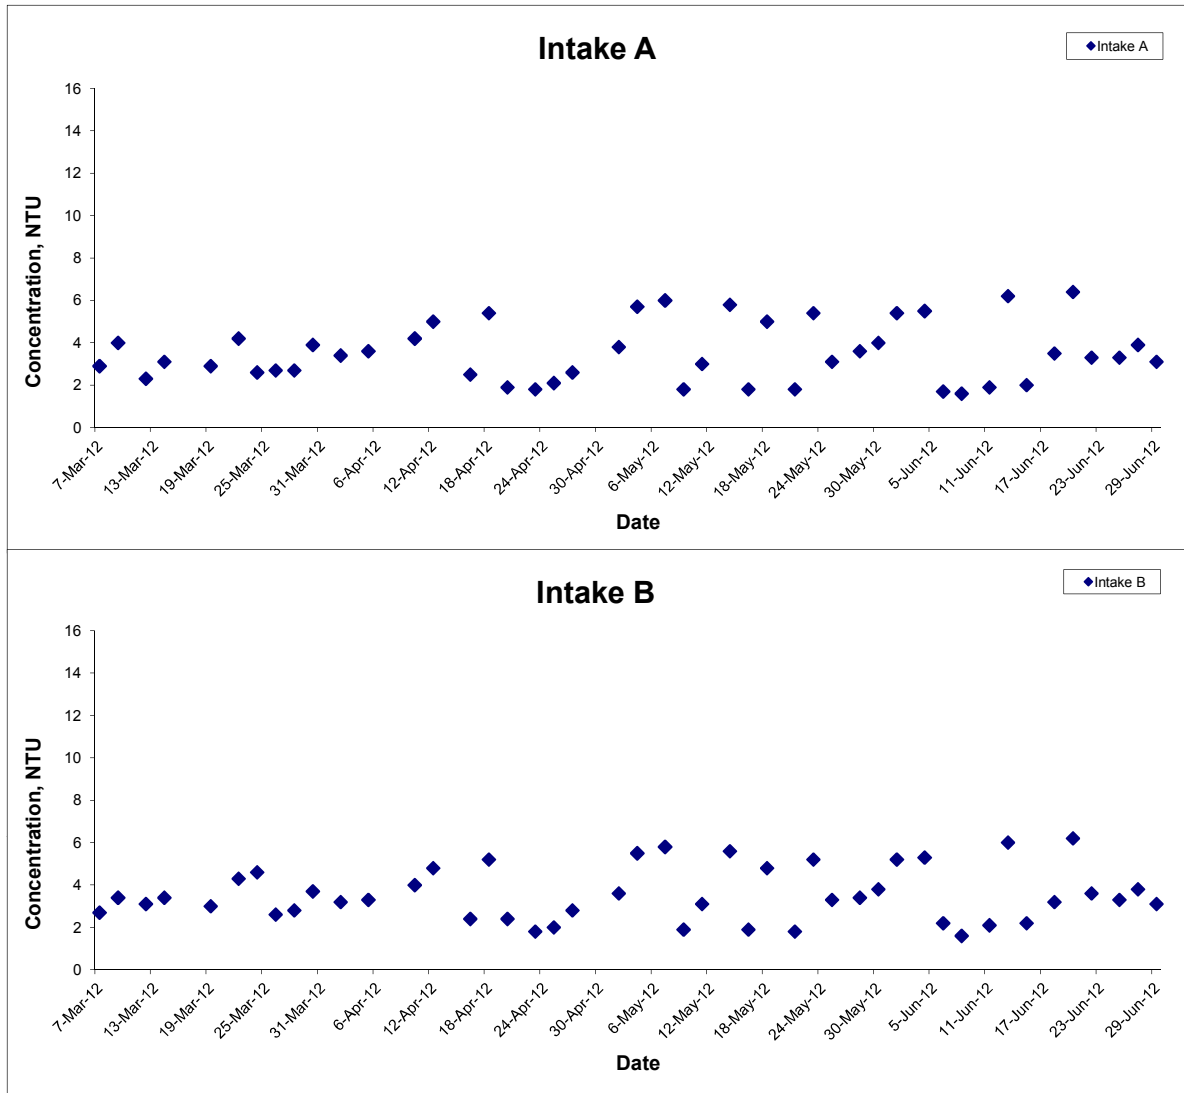

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	<b>CINOTECH</b>
	Date Jun 12	Appendix L	

## Turbidity (Depth-averaged) at Mid-Flood Tide

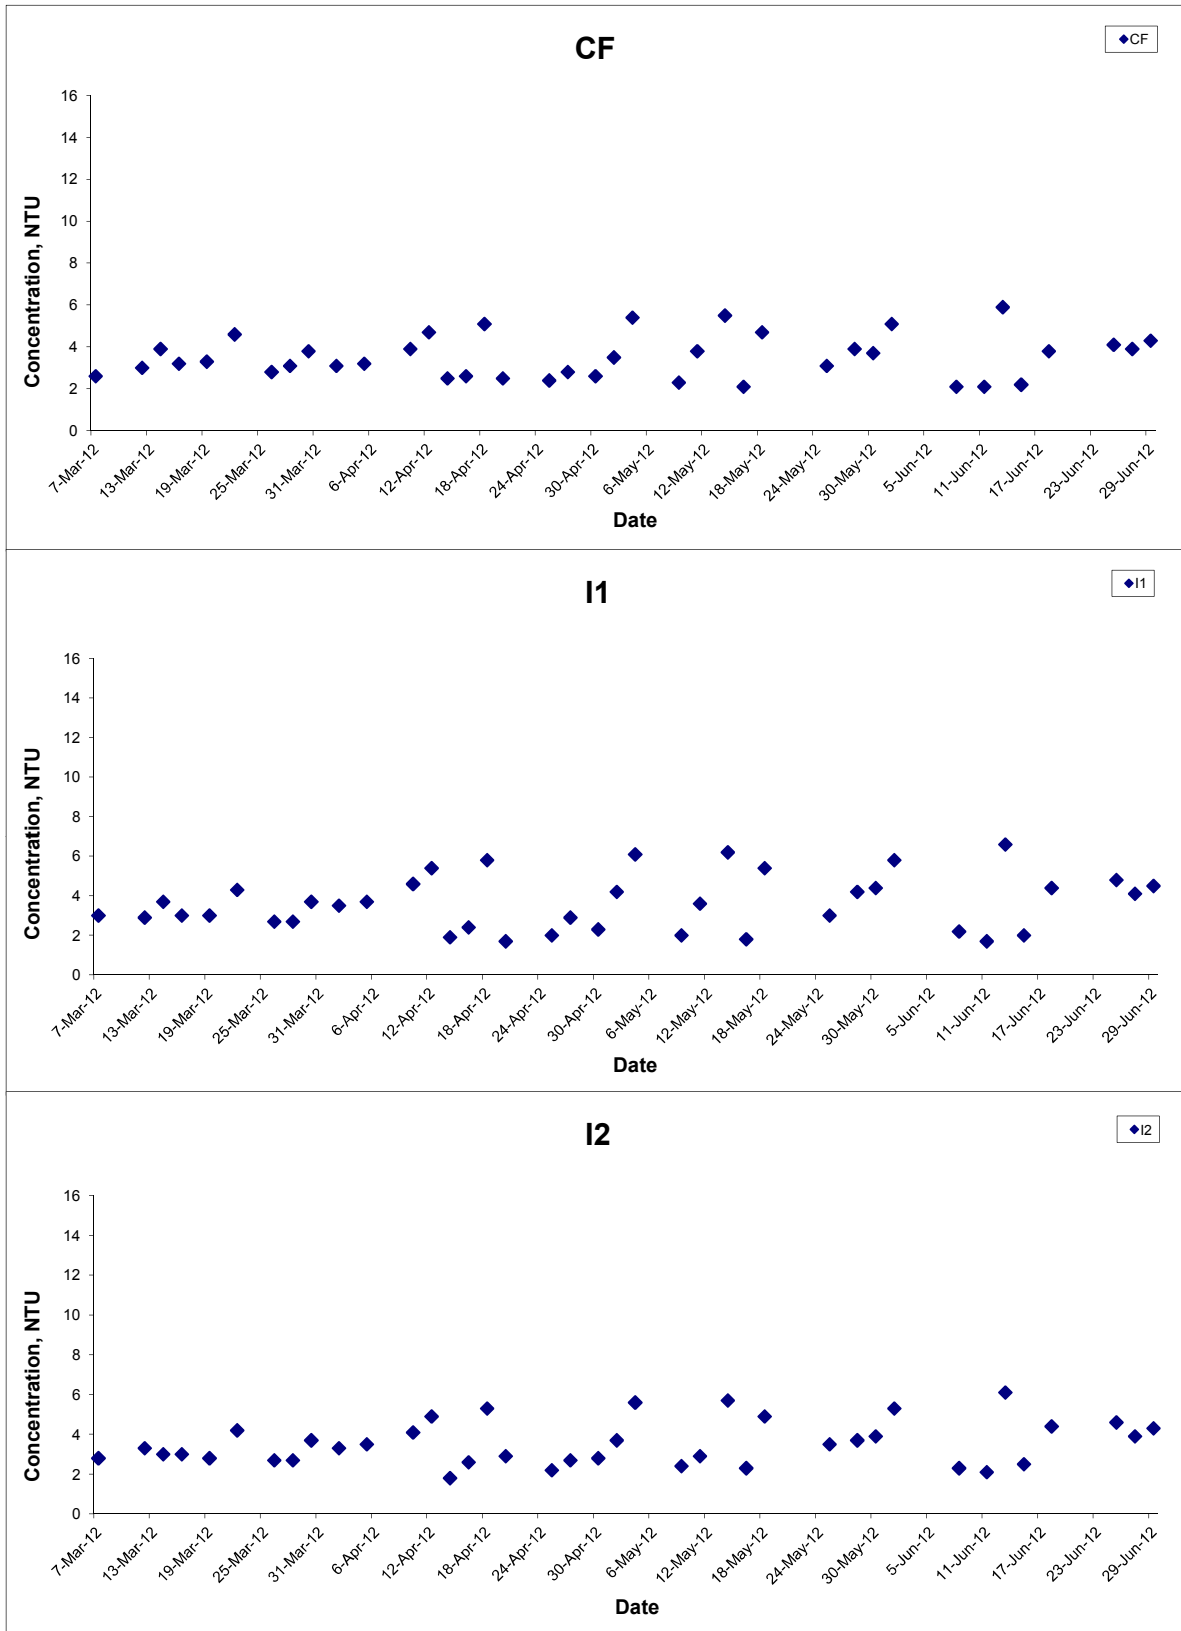


Title  
 Contract No. DC/2007/10  
 Design and Construction of Hong Kong West Drainage Tunnel  
 Graphical Presentation of Water Quality  
 Monitoring Results

Scale  
 N.T.S  
 Date  
 Jun 12

Project  
 No. MA8001  
 Appendix  
 L




## Turbidity (Depth-averaged) at Mid-Flood Tide

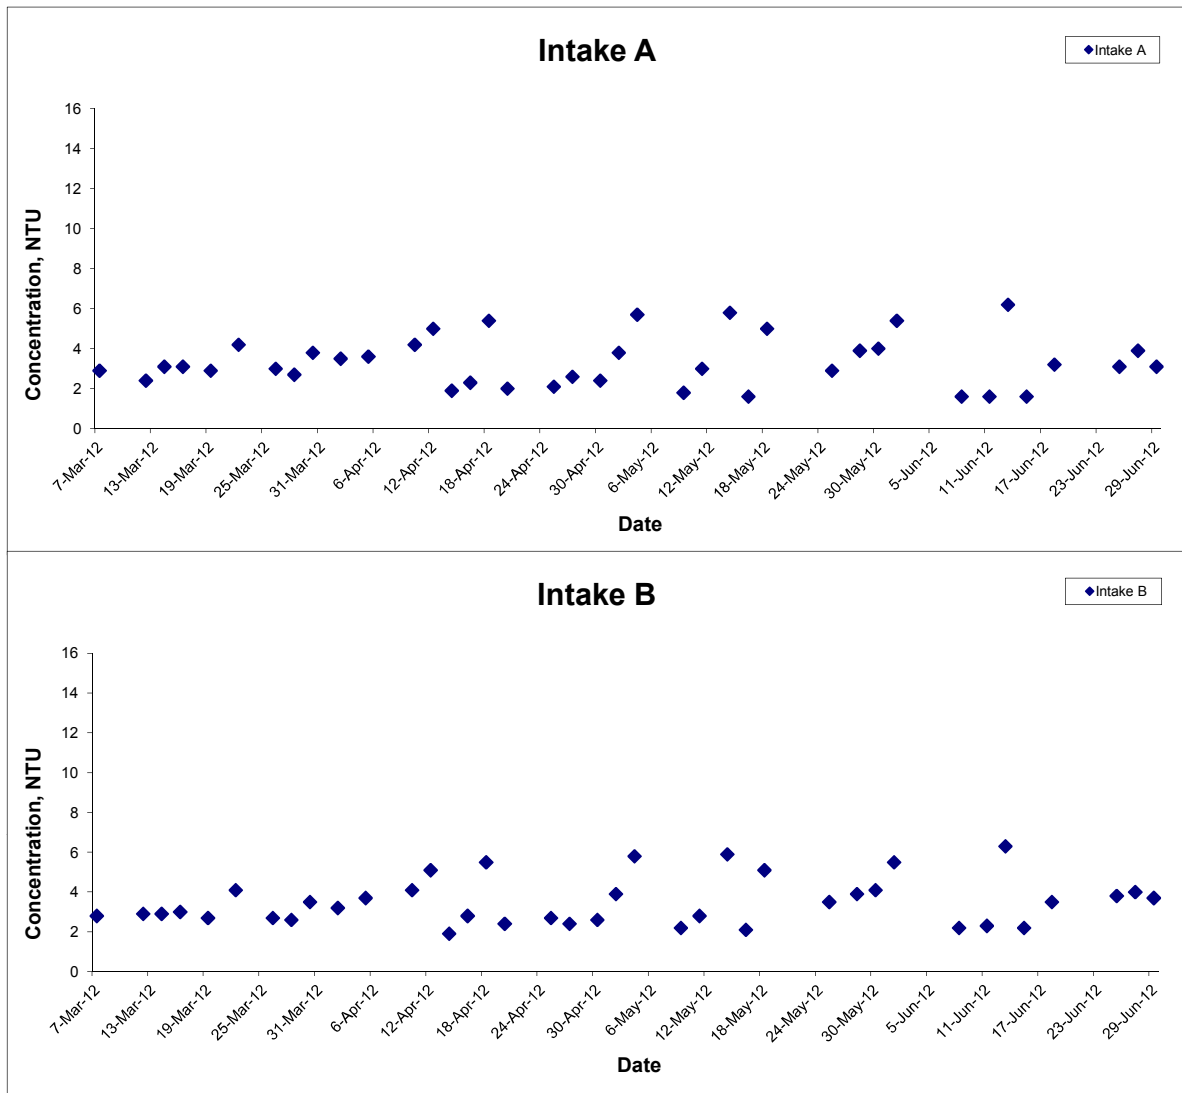


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale	N.T.S	Project No. MA8001	<b>CINOTECH</b>
	Date	Jun 12	Appendix L	

## Suspended Solids (Depth-averaged) at Mid-Ebb Tide

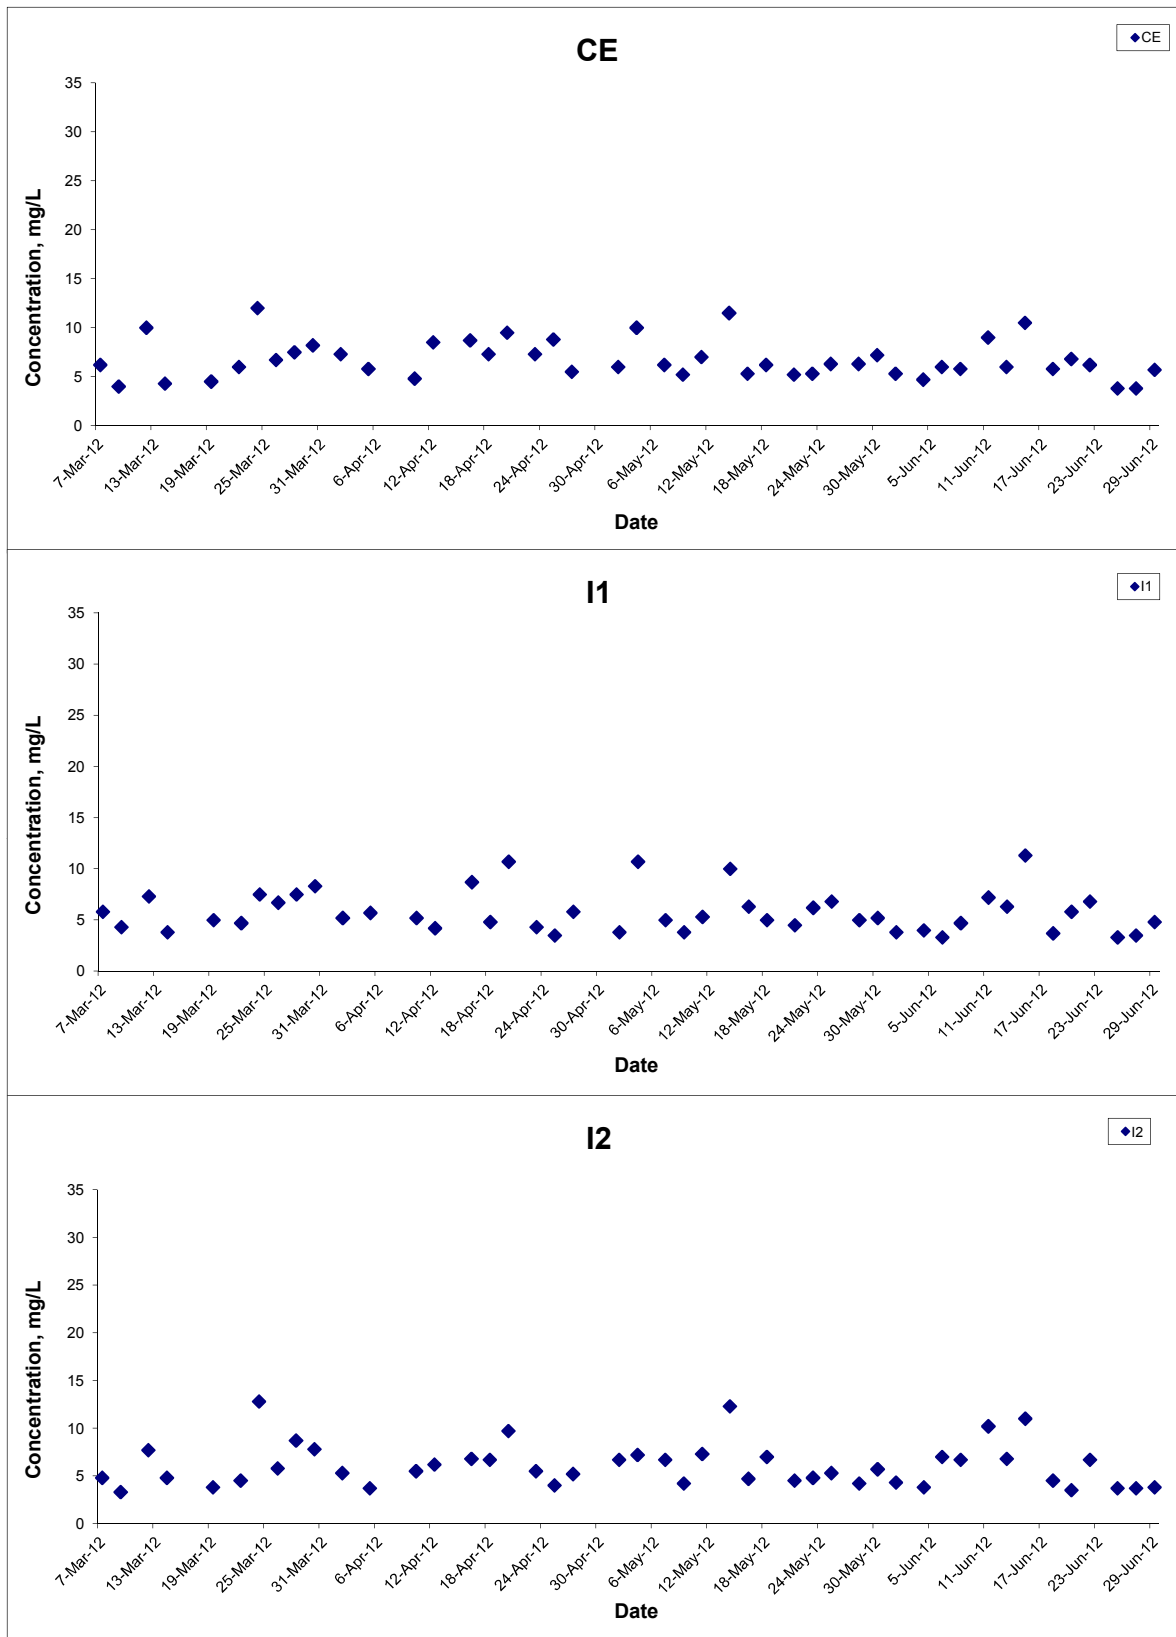


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale	N.T.S	Project No. MA8001	CINOTECH
	Date	Jun 12	Appendix L	

## Suspended Solids (Depth-averaged) at Mid-Ebb Tide

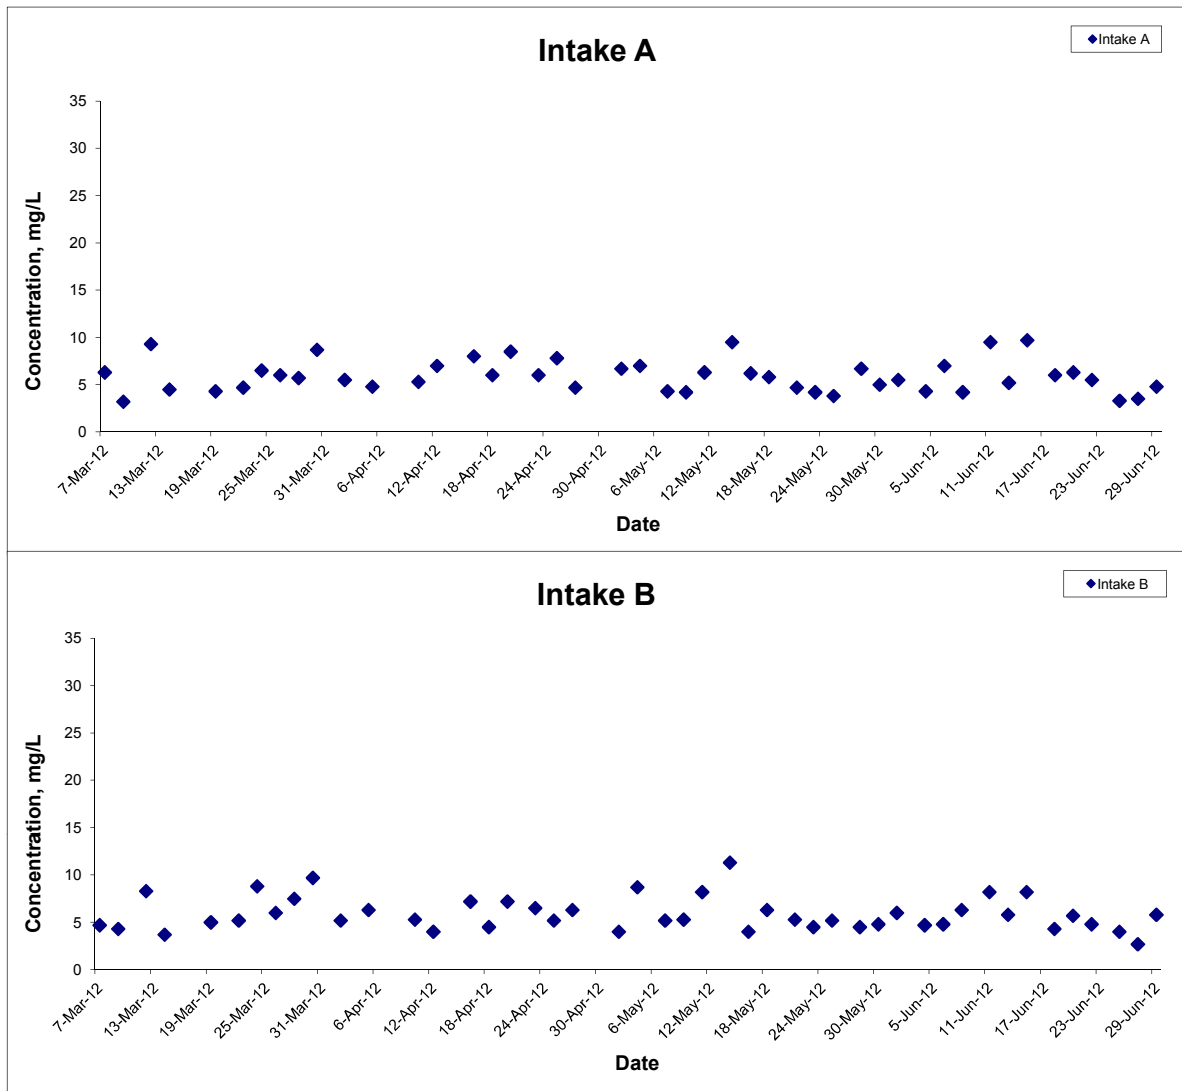


Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	CINOTECH
	Date Jun 12	Appendix L	

## Suspended Solids (Depth-averaged) at Mid-Flood Tide

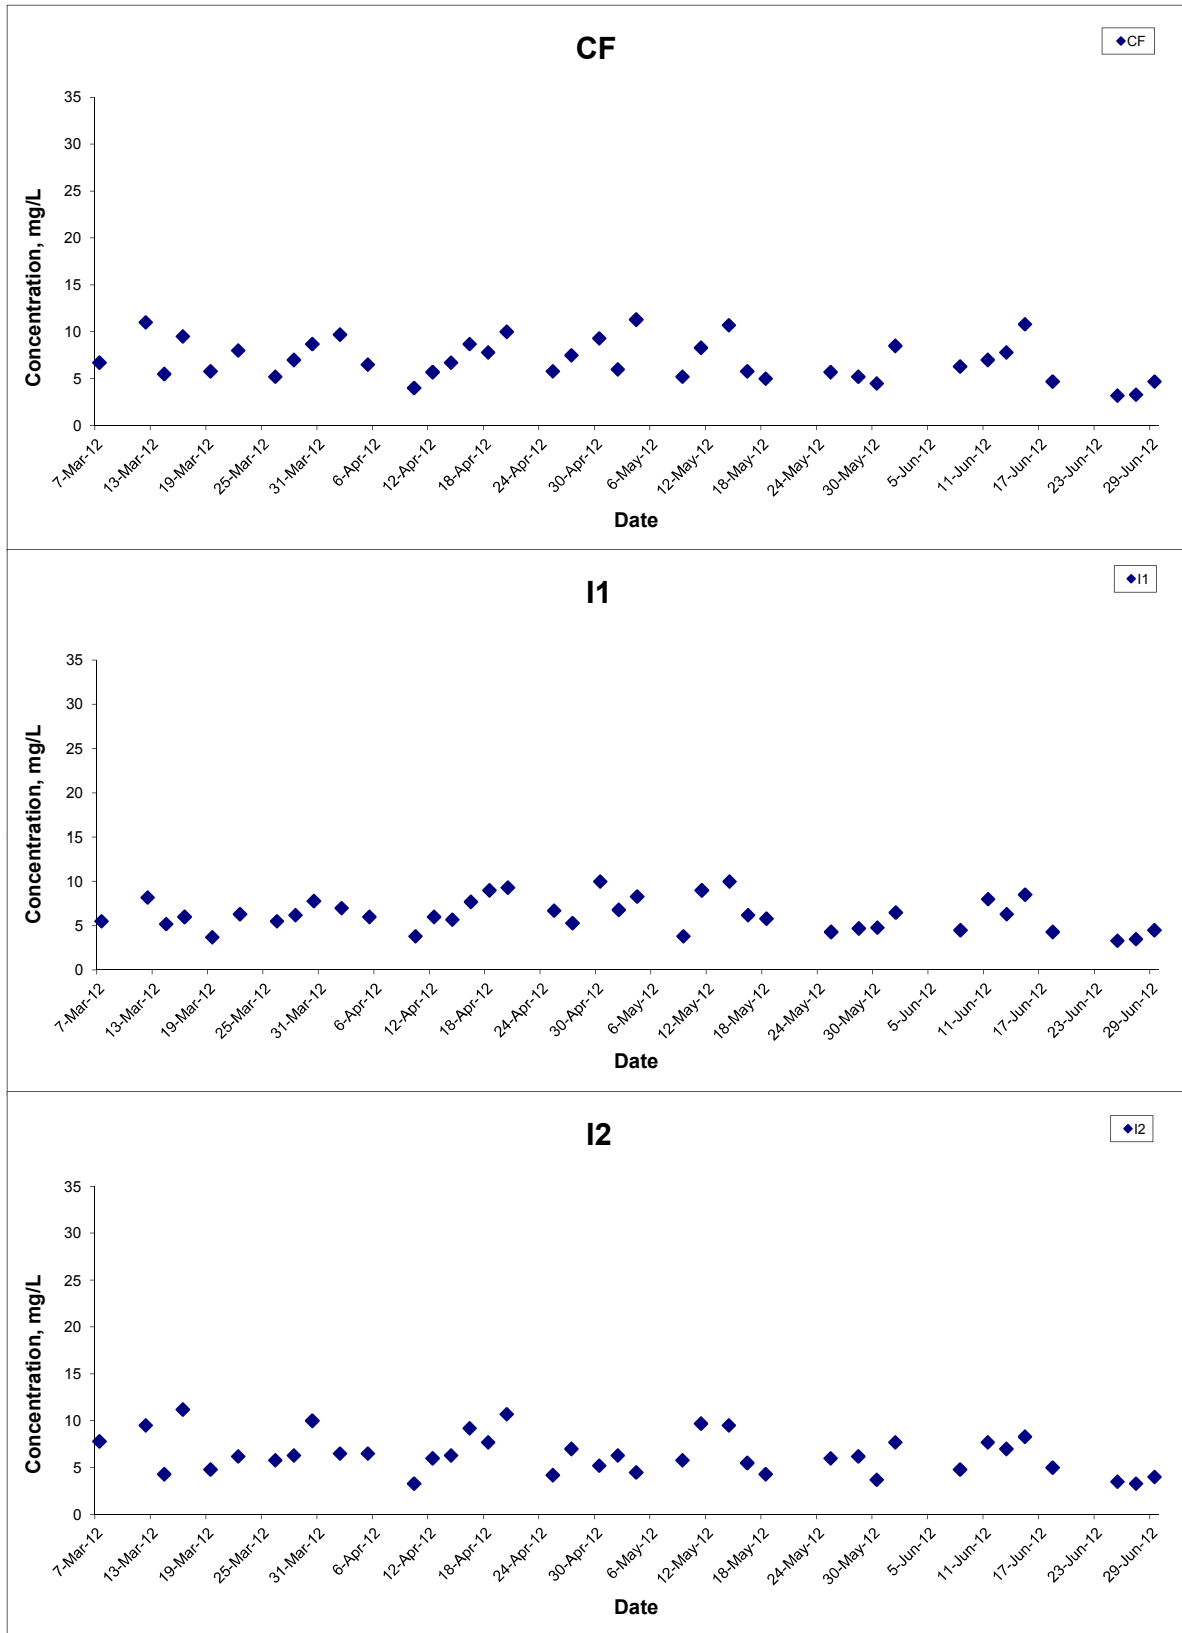

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	
	Date Jun 12	Appendix L	

## Suspended Solids (Depth-averaged) at Mid-Flood Tide

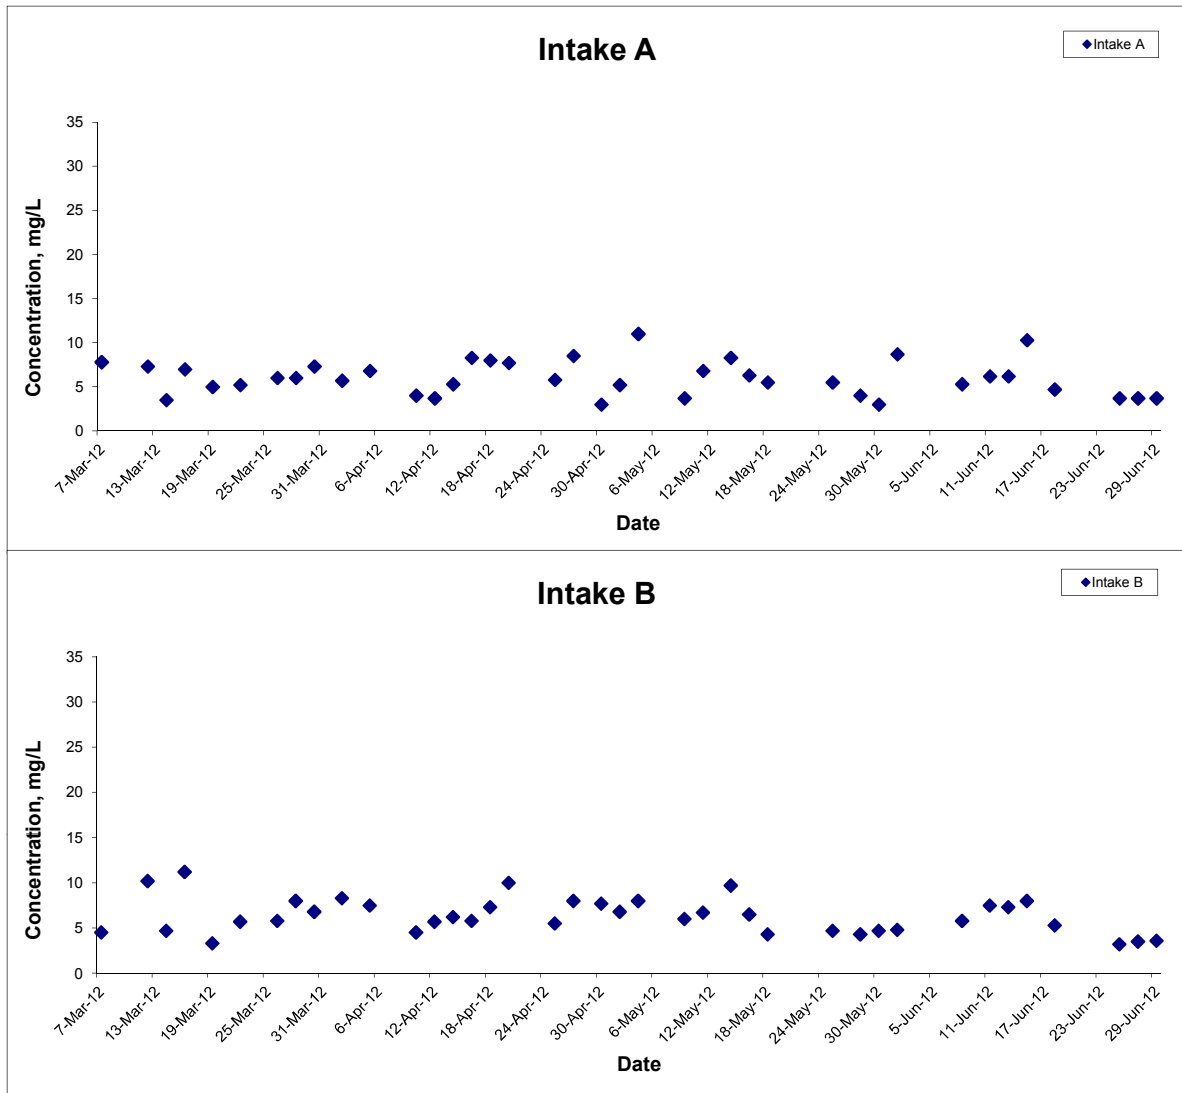

Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel  Graphical Presentation of Water Quality Monitoring Results	Scale N.T.S	Project No. MA8001	
	Date Jun 12	Appendix L	