

Dragages-Nishimatsu Joint Venture


Contract No. DC/2007/10

Design and Construction of Hong Kong West Drainage Tunnel

Quarterly EM&A Report

April to June 2013

(version 2.0)

| | |
|--------------|---|
| Certified By |  (Environmental Team Leader) |
|--------------|---|

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

CINOTECH CONSULTANTS LTD

Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong
Tel: (852) 2151 2083 Fax: (852) 3107 1388
Email: info@cinotech.com.hk

TABLE OF CONTENTS

| | Page |
|---|-----------|
| EXECUTIVE SUMMARY..... | 1 |
| KEY ISSUES FOR THE COMING MONTH..... | 8 |
| 1. INTRODUCTION..... | 9 |
| 2. PROJECT CHARACTERISTICS..... | 10 |
| PROJECT ORGANIZATION AND CONTACTS OF KEY MANAGEMENT | 10 |
| CONSTRUCTION PROGRAMME AND SYNOPSIS OF WORK | 11 |
| 3. ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS | 12 |
| MONITORING PARAMETERS AND MONITORING LOCATIONS | 12 |
| MONITORING METHODOLOGY AND CALIBRATION DETAILS | 12 |
| ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS)..... | 12 |
| ENVIRONMENTAL MITIGATION MEASURES..... | 12 |
| 4. MONITORING RESULTS | 13 |
| WEATHER CONDITIONS..... | 13 |
| AIR QUALITY | 13 |
| CONSTRUCTION AIRBORNE NOISE | 13 |
| CONSTRUCTION GROUND BORNE NOISE..... | 15 |
| WATER QUALITY | 15 |
| UNDERGROUND WATER LEVEL | 15 |
| 5. ENVIRONMENTAL AUDIT | 17 |
| IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES | 17 |
| SITE AUDIT SUMMARY | 17 |
| EFFECTIVENESS OF MITIGATION MEASURES..... | 18 |
| STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING | 18 |
| STATUS OF WASTE MANAGEMENT | 19 |
| 6. NON-COMPLIANCE (EXCEEDANCES) OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS)..... | 20 |
| SUMMARY OF EXCEEDANCES..... | 20 |
| CONSTRUCTION IMPACTS ON WATER QUALITY | 20 |
| REVIEW OF THE REASONS FOR AND THE IMPLICATIONS OF NON-COMPLIANCE | 20 |
| 7. ENVIRONMENTAL COMPLAINTS AND PROSECUTIONS..... | 21 |
| 8. COMMENTS, CONCLUSIONS AND RECOMMENDATIONS..... | 22 |

LIST OF TABLE

| | |
|-----------|--|
| Table I | Summary Table for Non-compliance Recorded in the Reporting Quarter |
| Table II | Summary Table for Key Information in the Reporting Quarter |
| Table 2.1 | Key Project Contacts |

LIST OF FIGURES

| | |
|---------------|--|
| Figure 1 | Layout Plan of the Project |
| Figure 2 | Organization Chart |
| Figure 3.1a | Locations of Air Quality and Construction Noise Monitoring Stations at Eastern Portal |
| Figure 3.1b | Locations of Air Quality and Construction Noise Monitoring Stations at Western Portal |
| Figure 3.1c | Locations of Construction Noise Monitoring Stations at Intake E7 |
| Figure 3.1d | Locations of Construction Noise Monitoring Stations at Intake PFLR1 |
| Figure 3.1e | Locations of Construction Noise Monitoring Stations at Intake W0 |
| Figure 3.1f | Locations of Construction Noise Monitoring Stations at Intake RR1 |
| Figure 3.1g | Locations of Construction Airborne and Ground borne Noise Monitoring Stations at Intake W5 |
| Figure 3.1h | Locations of Construction Noise Monitoring Stations at Intake E5A |
| Figure 3.1i | Locations of Construction Noise Monitoring Stations at Intake THR2 |
| Figure 3.1j | Locations of Construction Noise Monitoring Stations at Intake P5 |
| Figure 3.1k | Locations of Construction Noise Monitoring Stations at Intake W8 |
| Figure 3.1l | Locations of Construction Noise Monitoring Stations at Intake DG1 |
| Figure 3.1m | Locations of Construction Noise Monitoring Stations at Intake MA14 |
| Figure 3.1n | Locations of Construction Noise Monitoring Stations at Intake BR6 |
| Figure 4.1a-b | Locations of Water Quality Monitoring Stations |
| Figure 4.2a-e | Location of Ground Water Level Monitoring Stations |

LIST OF APPENDICES

| | |
|---|--|
| A | Construction Programme |
| B | Monitoring Requirements |
| C | Action and Limit Levels for Air Quality, Noise and Water Quality |
| D | Graphical Presentation of Air Quality Monitoring Results |
| E | Graphical Presentation of Noise Monitoring Results |
| F | Environmental Mitigation Implementation Schedule (EMIS) |
| G | Site Audit Summary |
| H | Summary Status of Environmental Licences and Permits |
| I | Waste Generated Quantity |
| J | Summary of Exceedances |
| K | Complaint Log |

EXECUTIVE SUMMARY

Introduction

1. This is the 21st Quarterly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for the “Drainage Improvement in Northern Hong Kong Island – Hong Kong West Drainage Tunnel” (the Project). This summary report presents EM&A works performed in the period between April to June 2013.
2. The construction activities undertaken in the reporting quarter were:
 - Reinstatement works at CR1 and P5
 - Rectification works at P5, CR1, W0, W5, E7 and MA17; and
 - Environmental impact monitoring.

Environmental Monitoring Works

3. Environmental monitoring for the Project was performed regularly as stipulated in the Updated EM&A Manual and the results were checked and reviewed. Site audits were conducted once per week. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
4. Proposal for Temporary Suspension of Water Quality Monitoring Western Portal was submitted on 15th September 2009 and approved by EPD on 30th October 2009. Marine water quality monitoring was temporary suspended starting from 31st October 2009 until there is marine-based construction activities resumed at the Western Portal. The monitoring has resumed on 5th March 2012 and terminated on 24th October 2012 with approval of EPD.
5. In order to assess the effectiveness of the implementation of water quality mitigation measures at Western Portal, site inspections/audits were conducted at least twice per week at Western Portal starting from November 2009.
6. Summary of the non-compliance of the reporting month is tabulated in Table I.

Table I Summary Table for Non-compliance Recorded in the Reporting Quarter

| Parameter | Number of Exceedances due to the Project | | Action Taken | Results of Action Taken |
|----------------|--|-------------|--------------|-------------------------|
| | Action Level | Limit Level | | |
| Eastern Portal | | | | |
| April 2013 | | | | |
| 1-hr TSP | 0 | 0 | N.A. | N.A. |
| 24-hr TSP | 0 | 0 | N.A. | N.A. |
| Noise | 0 | 0 | N.A. | N.A. |
| May 2013 | | | | |
| 1-hr TSP | 0 | 0 | N.A. | N.A. |
| 24-hr TSP | 0 | 0 | N.A. | N.A. |
| Noise | 0 | 0 | N.A. | N.A. |
| June 2013 | | | | |
| 1-hr TSP | 0 | 0 | N.A. | N.A. |
| 24-hr TSP | 0 | 0 | N.A. | N.A. |
| Noise | 0 | 0 | N.A. | N.A. |
| Western Portal | | | | |
| April 2013 | | | | |
| 1-hr TSP | 0 | 0 | N.A. | N.A. |
| 24-hr TSP | 0 | 0 | N.A. | N.A. |
| Noise | 0 | 0 | N.A. | N.A. |
| Water Quality | 0 | 0 | N.A. | N.A. |
| May 2013 | | | | |
| 1-hr TSP | 0 | 0 | N.A. | N.A. |
| 24-hr TSP | 0 | 0 | N.A. | N.A. |
| Noise | 0 | 0 | N.A. | N.A. |
| June 2013 | | | | |
| 1-hr TSP | 0 | 0 | N.A. | N.A. |
| 24-hr TSP | 0 | 0 | N.A. | N.A. |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake BR6 | | | | |
| April 2013 | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| May 2013 | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| June 2013 | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake DG1 | | | | |
| April 2013 | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| May 2013 | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| June 2013 | | | | |
| Noise | 0 | 0 | N.A. | N.A. |

| | | | | |
|---------------------|---|---|------|------|
| Intake E5A | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake E7 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake MA14 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake PFLR1 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake RR1 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake THR2 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |

| | | | | |
|-------------------|---|---|------|------|
| Intake W0 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake W5 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake W8 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| Intake P5 | | | | |
| <i>April 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>May 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |
| <i>June 2013</i> | | | | |
| Noise | 0 | 0 | N.A. | N.A. |

*Air Quality**1-hour TSP Monitoring*

7. 1-hour TSP monitoring at 2 monitoring stations, AQ1 and AQ2, was conducted as scheduled in the reporting period. No Action/Limit Level exceedance was recorded for 1-hr TSP monitoring in the reporting quarter.

24-hour TSP Monitoring

8. 24-hr TSP monitoring at 3 monitoring station, AQ1, AQ3 and AQ3a, was conducted as schedule in the reporting period except on 20 and 26 June 2013 at AQ3a (Please refer to section 4.3 and 4.4). No Action/Limit Level exceedance was recorded for 24-hr TSP monitoring in the reporting quarter.

Construction Airborne Noise

9. Noise monitoring at 18 monitoring stations, at NC1, NC2, NC3, NC4, NC5, NC6, NC7, NC8, NC9, NC10, NC11, NC12, NC13, NC15a, NC16, NC17, NC18 and NC19 were conducted as schedule in the reporting period.

Eastern Portal

10. No Action/Limit Level exceedance was recorded during the reporting period.

Western Portal

11. No Action/Limit Level exceedance was recorded during the reporting period.

Intake BR6

12. Construction noise monitoring at Intake BR6 was completed in mid November 2012.

Intake DG1

13. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake DG1 was completed on 5 April 2013.

Intake E5A

14. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake E5A was completed on 5 April 2013.

Intake E7

15. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake E7 was completed on 5 April 2013.

Intake MA14

16. Construction noise monitoring at Intake MA14 was completed in mid November 2012.

Intake PFLR1

17. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake PFLR1 was completed on 5 April 2013.

Intake RR1

18. No Action/Limit Level exceedance was recorded during the reporting period.

Intake THR2

19. Construction noise monitoring at Intake THR2 was completed by the end of July 2012.

Intake W0

20. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake W0 was completed on 5 April 2013.

Intake W5

21. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake W5 was completed on 5 April 2013.

Intake W8

22. No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake W8 was completed on 5 April 2013.

Intake P5

23. No Action/Limit Level exceedance was recorded during the reporting period.

Construction Ground Borne Noise

24. Construction Ground Borne Noise Monitoring at GNC3 was temporary suspended since 7th May 2009 as the ISS EastPoint Property Management Ltd. received an instruction from the Incorporated Owners of Aegean Terrace that we are not permitted to conduct any noise monitoring inside Aegean Terrace for the Project.
25. According to the approved EIA report, noise monitoring should be performed at NSR1a (i.e. Crane Court) when TBM is operating through the tunnel section between points A and B). Therefore, Ground borne noise monitoring has been conducted at Crane Court (GNC4) since 3rd June 2009 during the TBM operated.
26. Ground borne noise monitoring at GNC1 – True Light Middle School, GNC2 – The Legend and GNC4 – Crane Court were completed by end of August 2009 accordingly.
27. Ground borne noise monitoring at GNC5 was completed by end of November 2009.
28. Ground borne noise monitoring at GNC6 – French International School was completed by end of June 2010.
29. Ground borne noise monitoring at GNC7 – Hong Villa was completed by the end of November 2011.
30. Ground borne noise monitoring was conducted at GNC8 – Raimondi College was completed by the end of June 2012.

Environmental Licensing and Permitting

31. Licenses/Permits granted to the Project include the Environmental Permit (EP) for the Project, An Environmental Permit No. EP-272/2007 was issued on 26 April 2007 and Environmental Permit No. EP-272/2007/A was issue on 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture.
32. Registration of Chemical Waste Producer (License: 5213-148-D2393-02 for Eastern Portal and No. 5213-172-D2393-01 for Western Portal).

33. Water Discharge License (License No.: EP860/W10/XY0175 for Area of Mount Butler Office, EP860/W10/XY0177 for Eastern Portal, EP820/W9/XT086 and WT00005864-2010 for Western Portal, EP860/W10/XY0183 for Intake W0, WT00003737-2009 for Intake MB16, WT00004126-2009 for Intake HKU1, WT00003738-2009 for THR2, WT00004270-2009 for PFLR1, WT00004806-2009 for Intake E7, WT00004808-2009 for MBD2, WT00004885-2009 for Intake RR1, WT00005135-2009 for Intake W10, WT00005357-2009 for Intake W5, WT00005374-2009 for Intake P5, WT00005376-2009 for Intake TP4, WT00005588-2009 for Intake TP5, WT00005643-2009 for Intake E5A, WT00005754-2010 for Intake W8, WT00005954-2010 for Intake TP789, WT00005915-2010 for Intake E5B, WT00006102-2010 for Intake M3, WT00006415-2010 for Intake MA15, WT00006420-2010 for Intake MA17, WT00006428-2010 for Intake BR6, WT00006609-2010 for Intake HR1, WT00006559-2010 for Intake CR1, WT00006929-2010 for Intake W1, WT00006418-2010 for Intake MA14, WT00006865-2010 for Intake BR5, WT00007039-2010 for Intake DG1, WT00007042-2010 for Intake W3, WT00007043-2010 for Intake GL1, WT00007130-2010 for Intake BR4, WT00007139-2010 for Intake BR6 – SMH17 and WT00007319-2010 for Intake B2).
34. Construction Noise Permit (N/A)

Key Information in the Reporting Quarter

35. Summary of key information in the reporting quarter is tabulated in Table II.

Table II Summary Table for Key Information in the Reporting Quarter

| Event | Event Details | | Action Taken | Status | Remark |
|---|---------------|--------|--------------|--------|--------|
| | Number | Nature | | | |
| Complaint received | 0 | --- | N.A. | N.A. | --- |
| Changes to the assumptions and key construction / operation activities recorded | 0 | --- | N.A. | N.A. | --- |
| Notifications of any summons & prosecutions received | 0 | --- | N.A. | N.A. | --- |

Complaints and Prosecutions

36. No environmental complaints were received during the reporting quarter.
37. No warning, summon and notification of successful prosecution was received in the reporting period.

Future Key Issues

Key Issues for the Coming Month

38. Key environmental issues at Eastern and Western Portals, Intake MA16, MBD2, E5A, E5B, E7, PFLR1, RR1, THR2, W0, W5, P5, M3, TP4, TP5, TP789, HKU1, W10, W3, W8, MA15, MA17, GL1, HR1, W1, DG1, CR1, BR4, BR5, GL1, MA14 and BR6 in the coming month include:
- Runoff from exposed slope;
 - Wastewater and runoff discharge from site; and
 - Accumulation of general and construction waste on site.

1. INTRODUCTION

- 1.1 The Project “Drainage Improvement in Northern Hong Kong Island – Hong Kong West Drainage Tunnel” involves the construction of a drainage tunnel deep into the ground in Mid-levels of the Northern Hong Kong Island from Tai Hang to Pokfulam to intercept and convey the stormwater from the upper catchment directly to the sea near Cyberport. The Drainage tunnel alignment starts from the Eastern Portal near Haw Par Mansion in Tai Hang and ends at the Western Portal located to the north of Cyberport running underneath the Pok Fu Lam, Tai Tam, Aberdeen and Lung Fu Shan Country Parks. The underground main drainage tunnel is 6.25m-7.25m in diameter and about 11km long. Two portals and a series of connecting adits and drop shafts are also been constructed. The layout plan of the Project is shown in **Figure 1**.
- 1.2 The Environmental Impact Assessment (EIA) Report for the Project was approved on 7 April 2006 under the Environmental Impact Assessment Ordinance (EIAO). An Environmental Permit (EP-272/2007) for the works was also granted on 26 April 2007. A varied Environmental Permit (EP) (EP-272/2007/A) was issued in 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture. Environmental Monitoring and Audit (EM&A) Manual for the Project was also included as part of the EIA reports in the register. An updated EM&A Manual has been issued on 7 May 2008.
- 1.3 Drainage Services Department awarded the construction of the Project to Dragages-Nishimatsu Joint Venture (hereinafter called “the Contractor”). The construction works commenced on 30 November 2007 and are scheduled to be completed by 2012.
- 1.4 Cinotech Consultants Limited (Cinotech) was commissioned by the Contractor to undertake the Environmental Team (ET) Services for the Project. All environmental and audit works were conducted by Cinotech and the laboratory testing works were conducted by a HOKLAS laboratory, Wellab Limited. This is the 21st quarterly EM&A report summarizing the EM&A works for the Project in the period between April to June 2013.

2. PROJECT CHARACTERISTICS

Project Organization and Contacts of Key Management

- 2.1 Different parties with different levels of involvement in the project organization include:
- Project Proponent – Drainage Services Department (DSD).
 - The Supervising Officer or Supervising Officer's Representative (SO or SOR) – Ove Arup & Partners (ARUP).
 - Environmental Team (ET) – Cinotech Consultants Limited (CCL).
 - Independent Environmental Checker (IEC) – Allied Environmental Consultants Limited (AEC).
 - Contractor - Dragages-Nishimatsu Joint Venture (DNJV).
- 2.2 The responsibilities of respective parties are detailed in Sections 1.14 to 1.28 of the Updated EM&A Manual of the Project. The project organization chart is presented in **Figure 2**.
- 2.3 The key contacts of the Project are shown in Table 2.1.

Table 2.1 Key Project Contacts

| Party | Role | Name | Position | Phone No. | Fax No. |
|--------------|-----------------------------------|--------------------|---|------------------|----------------|
| DNJV | Permit Holder | Mr. UETAKE H. | Deputy Project Manager | 2671 7333 | 2671 9300 |
| ARUP | Supervising Officer | Mr. Kenny Wong | RE | 3476 0622 | 2436 1012 |
| Cinotech | Environmental Team | Dr. Priscilla Choy | ET Leader | 2151 2089 | 3107 1388 |
| | | Ms. Ivy Tam | Project Coordinator and Audit Team Leader | 2151 2090 | |
| | | Mr. Henry Leung | Monitoring Team Leader | 2151 2087 | |
| AEC | Independent Environmental Checker | Ms. Grace Kwok | Independent Environmental Checker | 2815 7028 | 2815 5399 |
| DNJV | Contractor | Mr. Carlson Wong | Environmental Officer | 3476 0834 | 2671 9300 |

Construction Programme and Synopsis of Work

2.4 The construction programme is presented in **Appendix A**.

3. ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS

Monitoring Parameters and Monitoring Locations

- 3.1 The EM&A Manual designates locations for the ET to monitor environmental impacts in terms of air quality, noise and water quality due to the Project. When alternative monitoring locations are proposed, the criteria listed in Section 2.4.3 of the updated EM&A Manual shall be followed and the updated monitoring locations shall be approved by ER and agreed with IEC. The Project area and monitoring locations are depicted in **Figures 3a-n and 4a-e. Appendix B** gives details of monitoring requirements.
- 3.2 Location of Outside the Site Office at Western Portal, the air quality monitoring station (AQ3) at nearby Western Portal, has been removed. No electricity supply was provided to the High Volume Sampler due to demolition of site office. Therefore, the proposed location (AQ3a) is shifted to the Temporary Site Office at Western Portal from the original location.

Monitoring Methodology and Calibration Details

- 3.3 Monitoring works/equipments were conducted/calibrated regularly in accordance with the EM&A Manual. Copies of calibration certificates are attached in the appendices of the Monthly Reports.

Environmental Quality Performance Limits (Action and Limit Levels)

- 3.4 The environmental quality performance limits, i.e. Action and Limit Levels were derived from the baseline monitoring results. Should the measured environmental quality parameters exceed the Action/Limit Levels, the respective action plans would be implemented. The Action/Limit Levels for each environmental parameter are given in **Appendix C**.

Environmental Mitigation Measures

- 3.5 Relevant mitigation measures as recommended in the project EIA report have been stipulated in the EM&A Manual for the Contractor to implement. A list of mitigation measures is given in **Appendix F**.

4. MONITORING RESULTS

Weather Conditions

- 4.1 The weather during monitoring sessions was mainly sunny and cloudy. The weather conditions for each individual monitoring session were presented in the field record sheets.

Air Quality

1-hour TSP Monitoring

- 4.2 1-hour TSP monitoring at 2 monitoring stations, AQ1 and AQ2, was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded for 1-hr TSP monitoring in the reporting quarter.

24-hour TSP Monitoring

- 4.3 24-hr TSP monitoring at 3 monitoring stations, AQ1, AQ3 and AQ3a was conducted as schedule in the reporting period except on 20 and 26 June 2013 at AQ3a. Power Supply to the HVS was removed in mid June 2013 due to the demolition of site office at Western Portal. No construction activities or rectification of defects were undertaken in Western Portal in the reporting month. The Portion of former Site Office was subsequently handed over to Nishimatsu Construction Co. Ltd. Construction Site of MTR SIL(E) Contract 902 in late June 2013.
- 4.4 The ET has consulted Nishimatsu Construction Co. Ltd. for provision of power supply to HVS at AQ3a. Their re-built of power supply system is anticipated to be finished on the second week of July 2013. The 24-hr TSP monitoring at AQ3a is expected to be resumed once the installation of power supply system is completed.
- 4.5 No Action/Limit Level exceedance was recorded for 24-hr TSP monitoring in the reporting quarter.
- 4.6 The graphical presentations of the air quality monitoring results are shown in **Appendix D**.

Construction Airborne Noise

- 4.7 Noise monitoring at 18 monitoring stations, NC1, NC2, NC3, NC4, NC5, NC6, NC7, NC8, NC9, NC10, NC11, NC12, NC13, NC15a, NC16, NC17, NC18 and NC19 were conducted as schedule in the reporting period.

Eastern Portal

- 4.8 No Action/Limit Level exceedance was recorded during the reporting period.

Western Portal

- 4.9 No Action/Limit Level exceedance was recorded during the reporting period.

Intake BR6

- 4.10 Construction noise monitoring at Intake BR6 was completed in mid November 2012.

Intake DG1

- 4.11 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake DG1 was completed on 5 April 2013.

Intake E5A

- 4.12 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake E5A was completed on 5 April 2013.

Intake E7

- 4.13 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake E7 was completed on 5 April 2013.

Intake MA14

- 4.14 Construction noise monitoring at Intake MA14 was completed in mid November 2012.

Intake PFLR1

- 4.15 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake PFLR1 was completed on 5 April 2013.

Intake RRI

- 4.16 No Action/Limit Level exceedance was recorded during the reporting period.

Intake THR2

- 4.17 Construction noise monitoring at Intake THR2 was completed by the end of July 2012.

Intake W0

- 4.18 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake W0 was completed on 5 April 2013.

Intake W5

- 4.19 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake W5 was completed on 5 April 2013.

Intake W8

- 4.20 No Action/Limit Level exceedance was recorded during the construction noise monitoring conducted in the reporting period. Construction noise monitoring at Intake W8 was completed on 5 April 2013.

Intake P5

- 4.21 No Action/Limit Level exceedance was recorded during the reporting period.

Construction Ground Borne Noise

- 4.22 Construction Ground Borne Noise Monitoring at GNC3 was temporary suspended since 7th May 2009 as the ISS EastPoint Property Management Ltd. received an instruction from the Incorporated Owners of Aegean Terrace that we are not permitted to conduct any noise monitoring inside Aegean Terrace for the Project.
- 4.23 According to the approved EIA report, noise monitoring should be performed at NSR1a (i.e. Crane Court) when TBM is operating through the tunnel section between points A and B). Therefore, Ground borne noise monitoring has been conducted at Crane Court (GNC4) since 3rd June 2009 during the TBM operated.
- 4.24 Ground borne noise monitoring at GNC1 – True Light Middle School, GNC2 – The Legend and GNC4 – Crane Court were completed by end of August 2009 accordingly.
- 4.25 Ground borne noise monitoring at GNC5 was completed by end of November 2009.
- 4.26 Ground borne noise monitoring at GNC6 – French International School was completed by end of June 2010.
- 4.27 Ground borne noise monitoring was conducted at GNC7 – Hong Villa was completed by the end of November 2011.
- 4.28 Ground borne noise monitoring was conducted at GNC8 – Raimondi College was completed by the end of June 2012.

Water Quality

- 4.29 Water quality monitoring was conducted as schedule in the reporting period. No Action/Limit Level exceedance was recorded. Water Quality Monitoring was terminated on 24th October 2012 with approval of EPD.

Underground Water Level

- 4.30 Ground water levels were measured once per month during the construction phase in order to ensure the water levels at those intakes near to the natural stream courses and thus on the surrounding habitats will not be significantly affected.
- 4.31 Locations of designated ground water level (borehole with piezometer) monitoring station UC1 at Eastern Portal has been changed to ADH48 which was verified by IEC on 5th June 2008. The updated ground water level monitoring stations, TP789_DH2, TP5_DH2, THR2_DH7 and PFLR1_DH2 were also verified by IEC on 19th June 2010. Monitoring data are shown in Table 4.2.

Table 4.2 Ground Water Level Monitoring Data in Reporting Quarter

| Date | Water Level (from ground)/m |
|---|-----------------------------|
| Location: ADH48 (Eastern Portal) | |
| 17 April 2013 | 7.60 |

| | |
|----------------------------|-------|
| 15 May 2013 | 7.60 |
| 14 June 2013 | 7.60 |
| Location: TP789_DH2 | |
| 17 April 2013 | 14.60 |
| 15 May 2013 | 14.60 |
| 14 June 2013 | 14.60 |
| Location: TP5_DH2 | |
| 17 April 2013 | 0.86 |
| 15 May 2013 | 0.86 |
| 14 June 2013 | 0.86 |
| Location: THR2_DH7 | |
| 17 April 2013 | 3.00 |
| 15 May 2013 | 3.00 |
| 14 June 2013 | 3.00 |
| Location: PFLR1_DH2 | |
| 17 April 2013 | 11.60 |
| 15 May 2013 | 11.60 |
| 14 June 2013 | 11.60 |

5. ENVIRONMENTAL AUDIT

Implementation Status of Environmental Mitigation Measures

- 5.1 The implementation status of environmental mitigation measures (EMIS) is given in **Appendix F**.

Site Audit Summary

- 5.2 During site inspections in the reporting period, no non-conformance was identified. The observations and recommendations made during the reporting period are summarized in **Appendix G**.

- 5.3 The major deficiencies identified by ET in the reporting quarter are summarized as follow:

Water Quality

- Provide sand bag bunding to gullies at Intake P5.

Waste/Chemical Management

- Drip tray should be provided to chemical container at P5.

- 5.4 The major deficiencies identified by IEC in the reporting quarter are summarized as follow:

25th April 2013

Follow up observations:

1. The contractor had covered all exposed surfaces with tarpaulin sheets with provision of sandbags next to the water-filled barriers (closed).

New Observations:

- No major environmental deficiency was observed.

Reminder:

- As wet season approaches, the contractor was reminded to closely monitor the condition of the mitigations measures and ensure no site water will enter the public area.

30th May 2013

New Observations:

No major environmental deficiency was observed.

13th June 2013

New Observations:

No major environmental deficiency was observed.

Effectiveness of Mitigation Measures

- 5.5 The mitigation measures recommended in the EIA report and required by the EP are considered effective in minimizing environmental impacts. The Contractor has implemented the recommended mitigation measures except those mitigation measures not applicable at this stage, it is however considered that the Contractor could put greater efforts into proper implementation of these measures, especially for the construction of noise enclosure and use of quiet PME, to ensure their intended effects are fully achieved.

Status of Environmental Licensing and Permitting

- 5.6 Licenses/Permits granted to the Project include the Environmental Permit (EP) for the Project, An Environmental Permit No. EP-272/2007 was issued on 26 April 2007 and Environmental Permit No. EP-272/2007/A was issue on 26 October 2007. Later, the further Environmental Permit (FEP-01/272/2007/A) and (FEP-01/272/2007/B) was issued on 28 January 2008 and 25 June 2009 to Dragages-Nishimatsu Joint Venture.
- 5.7 Registration of Chemical Waste Producer (License: 5213-148-D2393-02 for Eastern Portal and No. 5213-172-D2393-01 for Western Portal).
- 5.8 Water Discharge License (License No.: EP860/W10/XY0175 for Area of Mount Butler Office, EP860/W10/XY0177 for Eastern Portal, EP820/W9/XT086 and WT00005864-2010 for Western Portal, EP860/W10/XY0183 for Intake W0, WT00003737-2009 for Intake MB16, WT00004126-2009 for Intake HKU1, WT00003738-2009 for THR2, WT00004270-2009 for PFLR1, WT00004806-2009 for Intake E7, WT00004808-2009 for MBD2, WT00004885-2009 for Intake RR1, WT00005135-2009 for Intake W10, WT00005357-2009 for Intake W5, WT00005374-2009 for Intake P5, WT00005376-2009 for Intake TP4, WT00005588-2009 for Intake TP5, WT00005643-2009 for Intake E5A, WT00005754-2010 for Intake W8, WT00005954-2010 for Intake TP789, WT00005915-2010 for Intake E5B, WT00006102-2010 for Intake M3, WT00006415-2010 for Intake MA15, WT00006420-2010 for Intake MA17, WT00006428-2010 for Intake BR6, WT00006609-2010 for Intake HR1, WT00006559-2010 for Intake CR1, WT00006929-2010 for Intake W1, WT00006418-2010 for Intake MA14, WT00006865-2010 for Intake BR5, WT00007039-2010 for Intake DG1, WT00007042-2010 for Intake W3, WT00007043-2010 for Intake GL1, WT00007130-2010 for Intake BR4, WT00007139-2010 for Intake BR6 – SMH17 and WT00007319-2010 for Intake B2).
- 5.9 Construction Noise Permit (N/A)
- 5.10 The status of these licenses and permits obtained for the Project is summarized in **Appendix H**.

Status of Waste Management

- 5.11 During this reporting quarter, a total of 22 nos. of dump trucks of waste were delivered to SENT, 0 trips of C&D waste were delivered to Tuen Mun Fill Bank. 31 and 3 trips of C&D waste were delivered to Chai Wan Public Barging Point and TKO Fill Bank respectively. Both the trip ticket system and chit accounting system for disposal of waste were operating smoothly to date. 2 trucks overloading case was recorded during this reporting period (all cases were within the 105% allowable buffer weight). No disposal of inert C&D material to public sorting facilities and no dump truck without cover were reported from CEDD. In respect of the dump truck cover, DNJV keeps on take record photos and inspection to ensure that all dump trucks have fully covered the skip before leaving the site.
- 5.12 The rock materials from the Eastern Portal and Western Portal were received by the alternative disposal sites at ZhongShan. Some of the tunnel spoils from adits were also received by Nishimatsu Construction Co. Ltd. Construction Site of MTR SIL(E) Contract 902 which was started from 30th June 2011.
- 5.13 The monthly summary of waste flow table for April to June 2013 is provided in **Appendix I**.

6. NON-COMPLIANCE (EXCEEDANCES) OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS)

Summary of Exceedances

- 6.1 Environmental monitoring works were performed in the reporting period and all monitoring results were checked and reviewed. A summary of exceedances is attached in **Appendix J**. The details of each exceedance were attached in the Monthly Reports.

Air Quality

- 6.2 No Action/ Limit Level exceedance was recorded in the reporting quarter.

Construction Airborne Noise

Eastern Portal

- 6.3 No Action/ Limit Level exceedance was recorded in the reporting quarter.

Western Portal

- 6.4 No Action/ Limit Level exceedance was recorded in the reporting quarter.

Intakes

- 6.5 No Action/ Limit Level exceedance was recorded in the reporting quarter.

Construction Ground Borne Noise

- 6.6 All ground borne noise monitoring was completed by the end of June 2012.

Construction Impacts on Water Quality

- 6.7 All water quality monitoring was terminated on 24 October 2012.

Review of the Reasons for and the Implications of Non-compliance

- 6.8 There was no non-compliance from the site audits in the reporting quarter. The observations and recommendations made in each individual site audit session were attached in the Monthly Reports.

7. ENVIRONMENTAL COMPLAINTS AND PROSECUTIONS

- 7.1 No complaints were received during the reporting quarter. The Complaint Log is attached in **Appendix K**.
- 7.2 No warning, summon and notification of successful prosecution was received in the reporting period.
- 7.3 There were a total of 134 project related environmental complaints, no warnings, summons and successful prosecutions received since the commencement of the Project.

8. COMMENTS, CONCLUSIONS AND RECOMMENDATIONS

8.1 The major construction activities in the coming month include:

- Rectification works at CR1, W0, W5, E7 and MA17; and
- Environmental impact monitoring.

8.2 According to the environmental audit performed in the reporting period, the following recommendations were made:

Air Quality Impact

- To prohibit any open burning on site.
- To regularly maintain the machinery and vehicles on site.
- To implement dust suppression measures on all haul roads, stockpiles, dry surfaces and excavation works.
- To provide hoarding

Noise Impact

- To inspect the noise sources inside the site.
- To space out noisy equipment and position the equipment as far away as possible from sensitive receivers.
- To provide temporary noise barriers for operations of noisy equipment near the noise sensitive receivers in an appropriate location.

Water Impact

- To prevent any surface runoff discharge into any stream course.
- To review and implement temporary drainage system.
- To identify any wastewater discharges from site.
- To ensure properly maintenance for de-silting facilities.
- To clear the silt and sediment in the sedimentation tanks.
- To review the capacity of de-silting facilities for discharge.
- To divert all the water generated from construction site to de-silting facilities with enough handling capacity before discharge.
- To avoid accumulation of stagnant and ponding water on site.


Waste/Chemical Management

- To check for any accumulation of waste materials or rubbish on site.
- To ensure the performance of sorting of C&D materials at source (during generation);
- To carry out inspection of dump truck at site exit to ensure inert and non-inert


C&D materials are properly segregated before removing off site.


- To avoid any discharge or accidental spillage of chemical waste or oil directly from the site.
- To avoid improper handling or storage of oil drum on site.

FIGURES

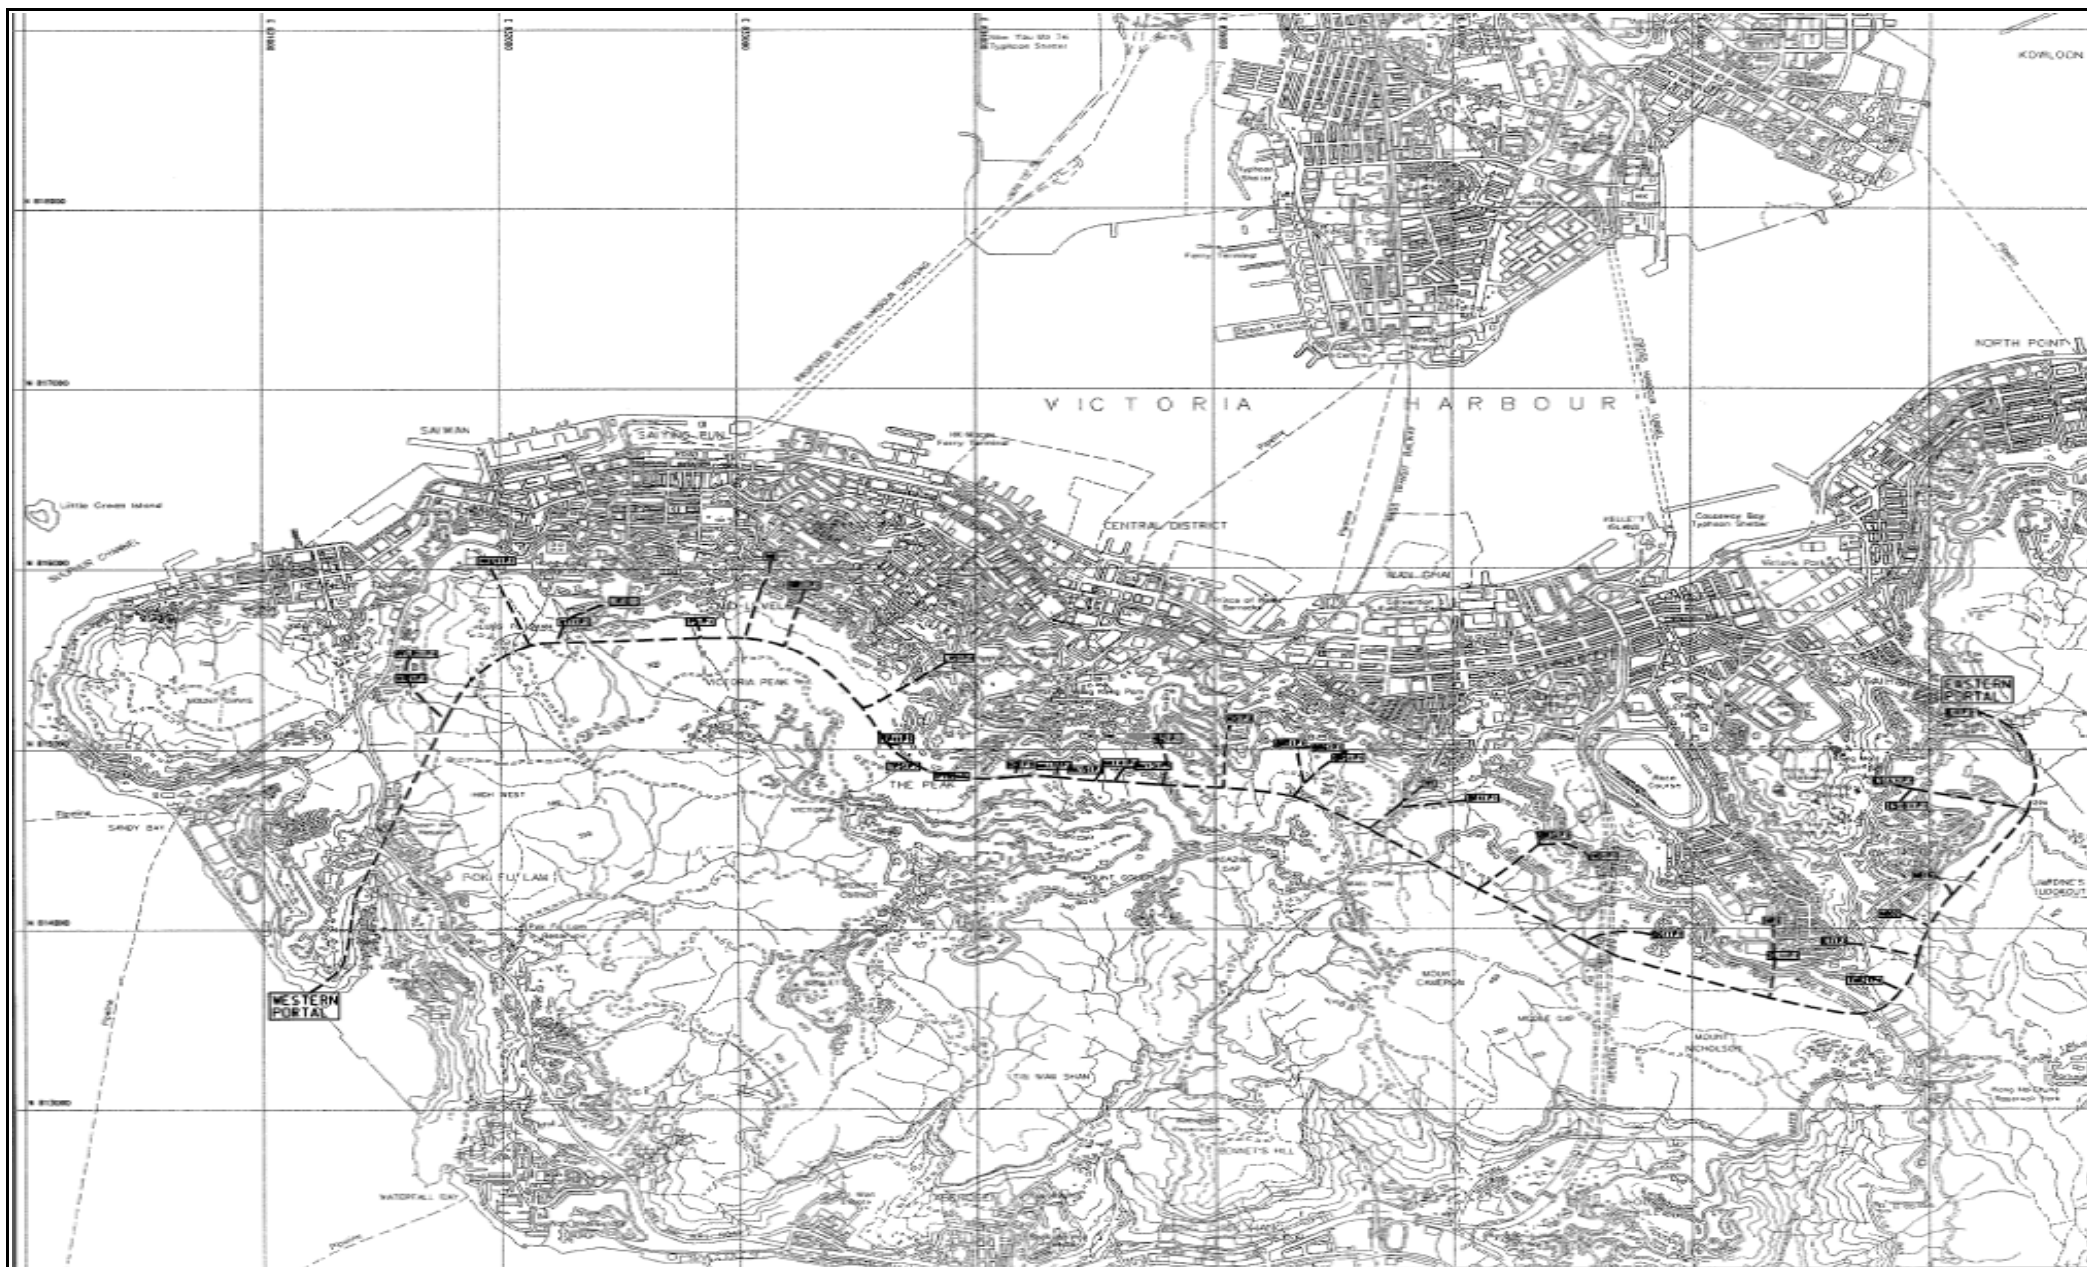

| | | | | |
|-------|--|--------|------------|----------|
| Title | Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Site Layout Plan | Scale | Project | CINOTECH |
| | | N.T.S | No. MA8001 | |
| | | Date | Figure | |
| | | Apr-08 | 1.1 | |

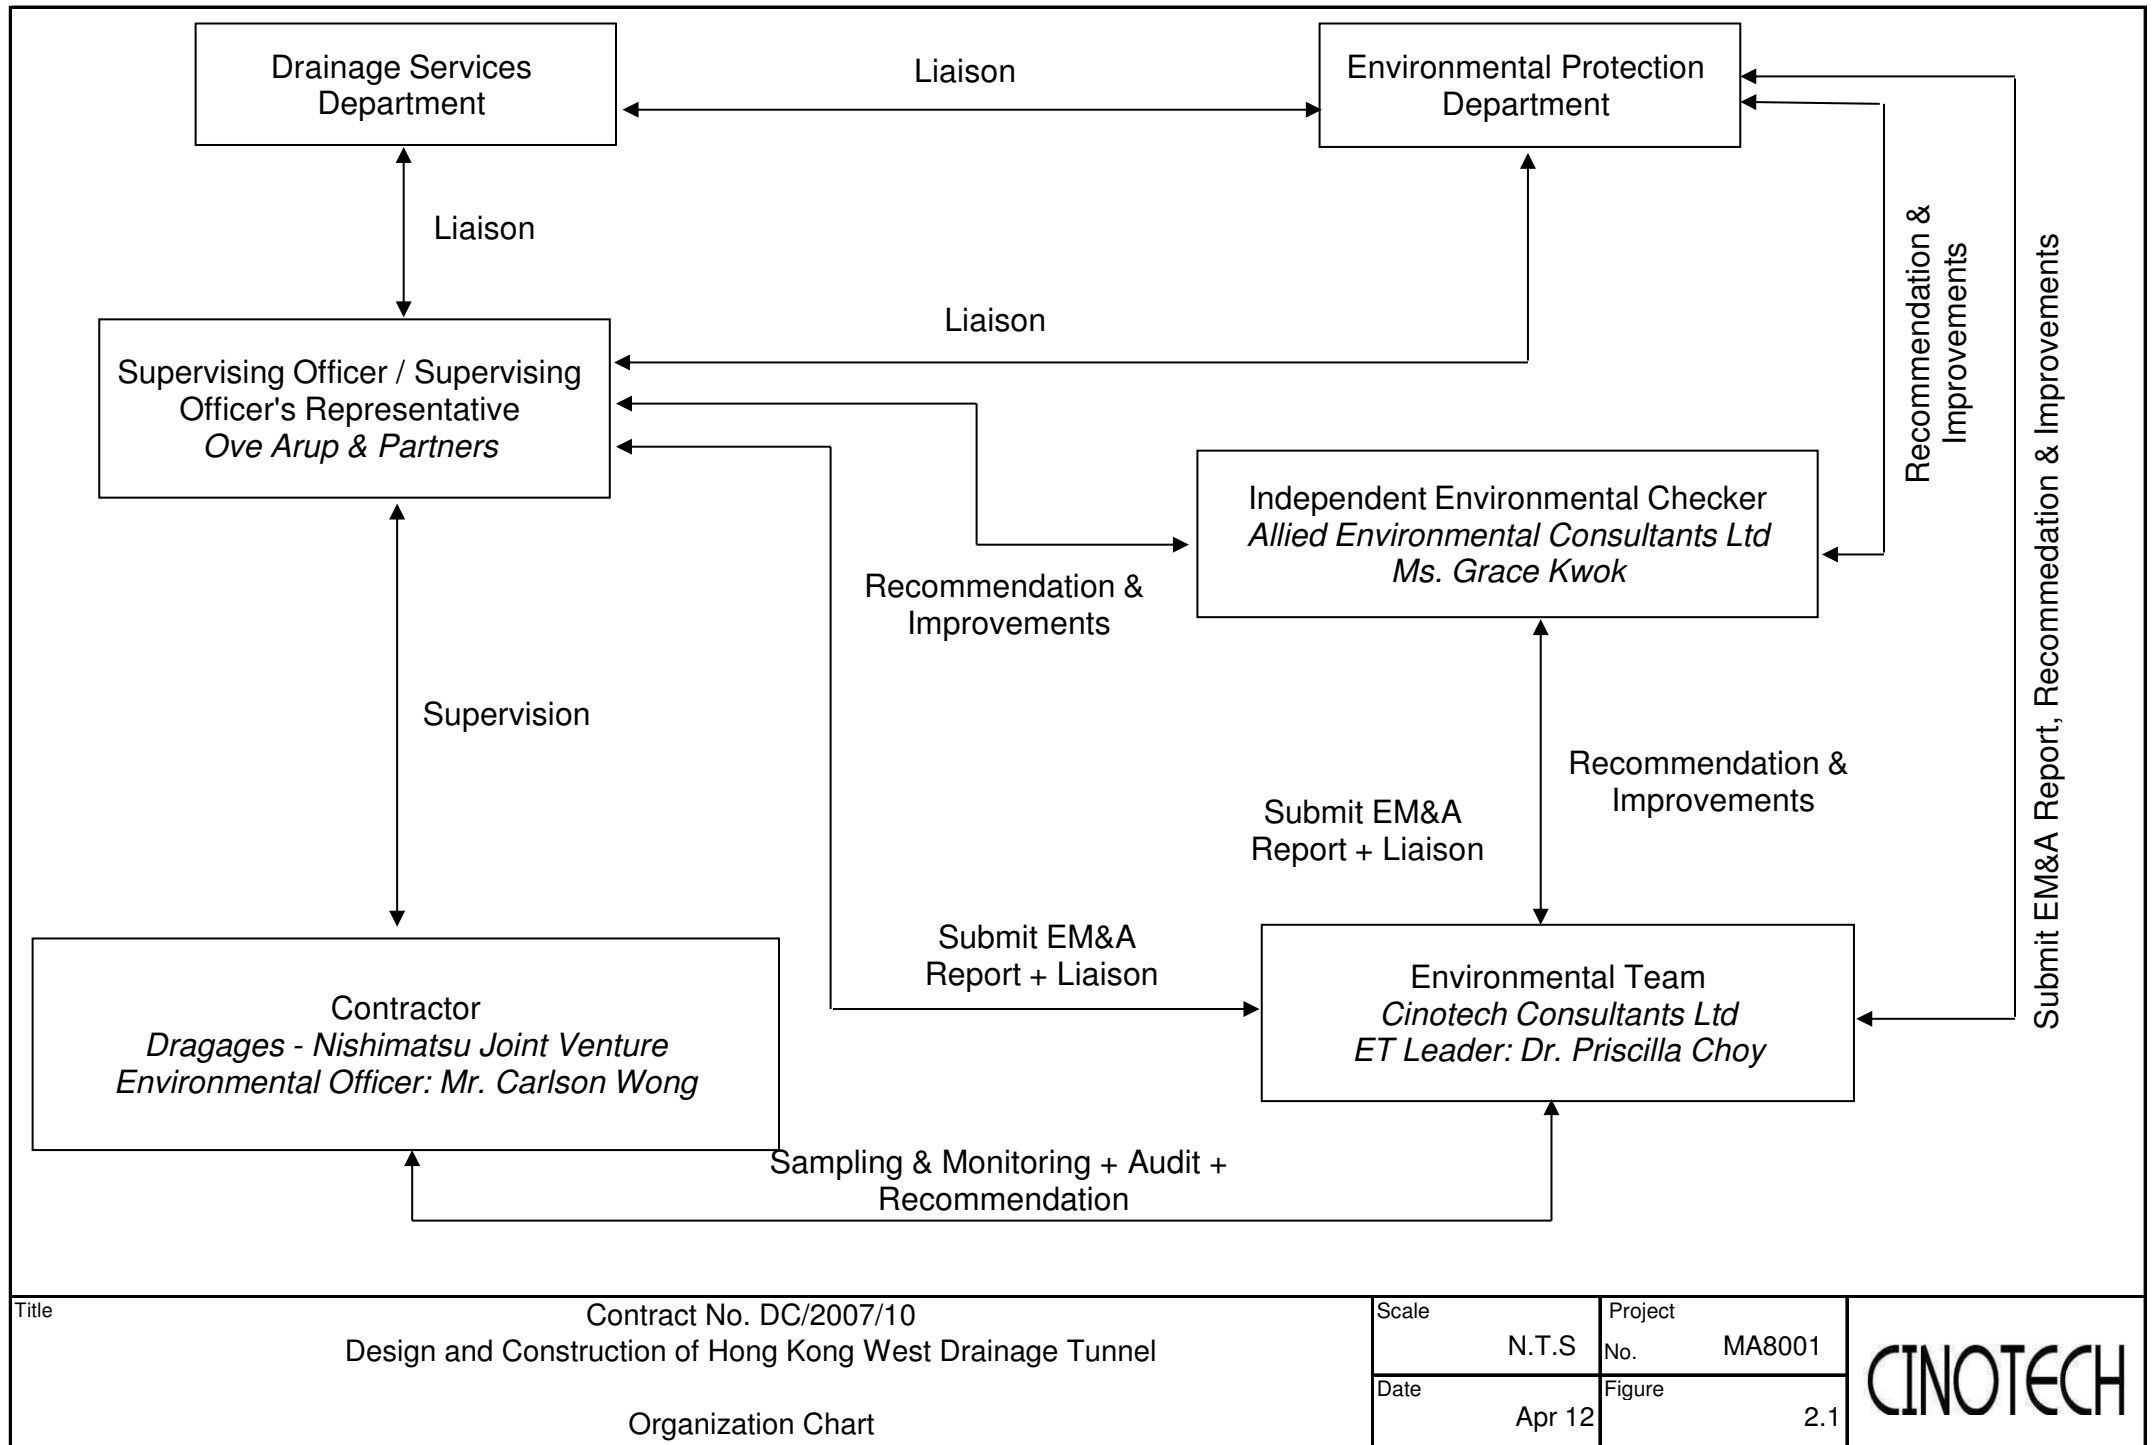

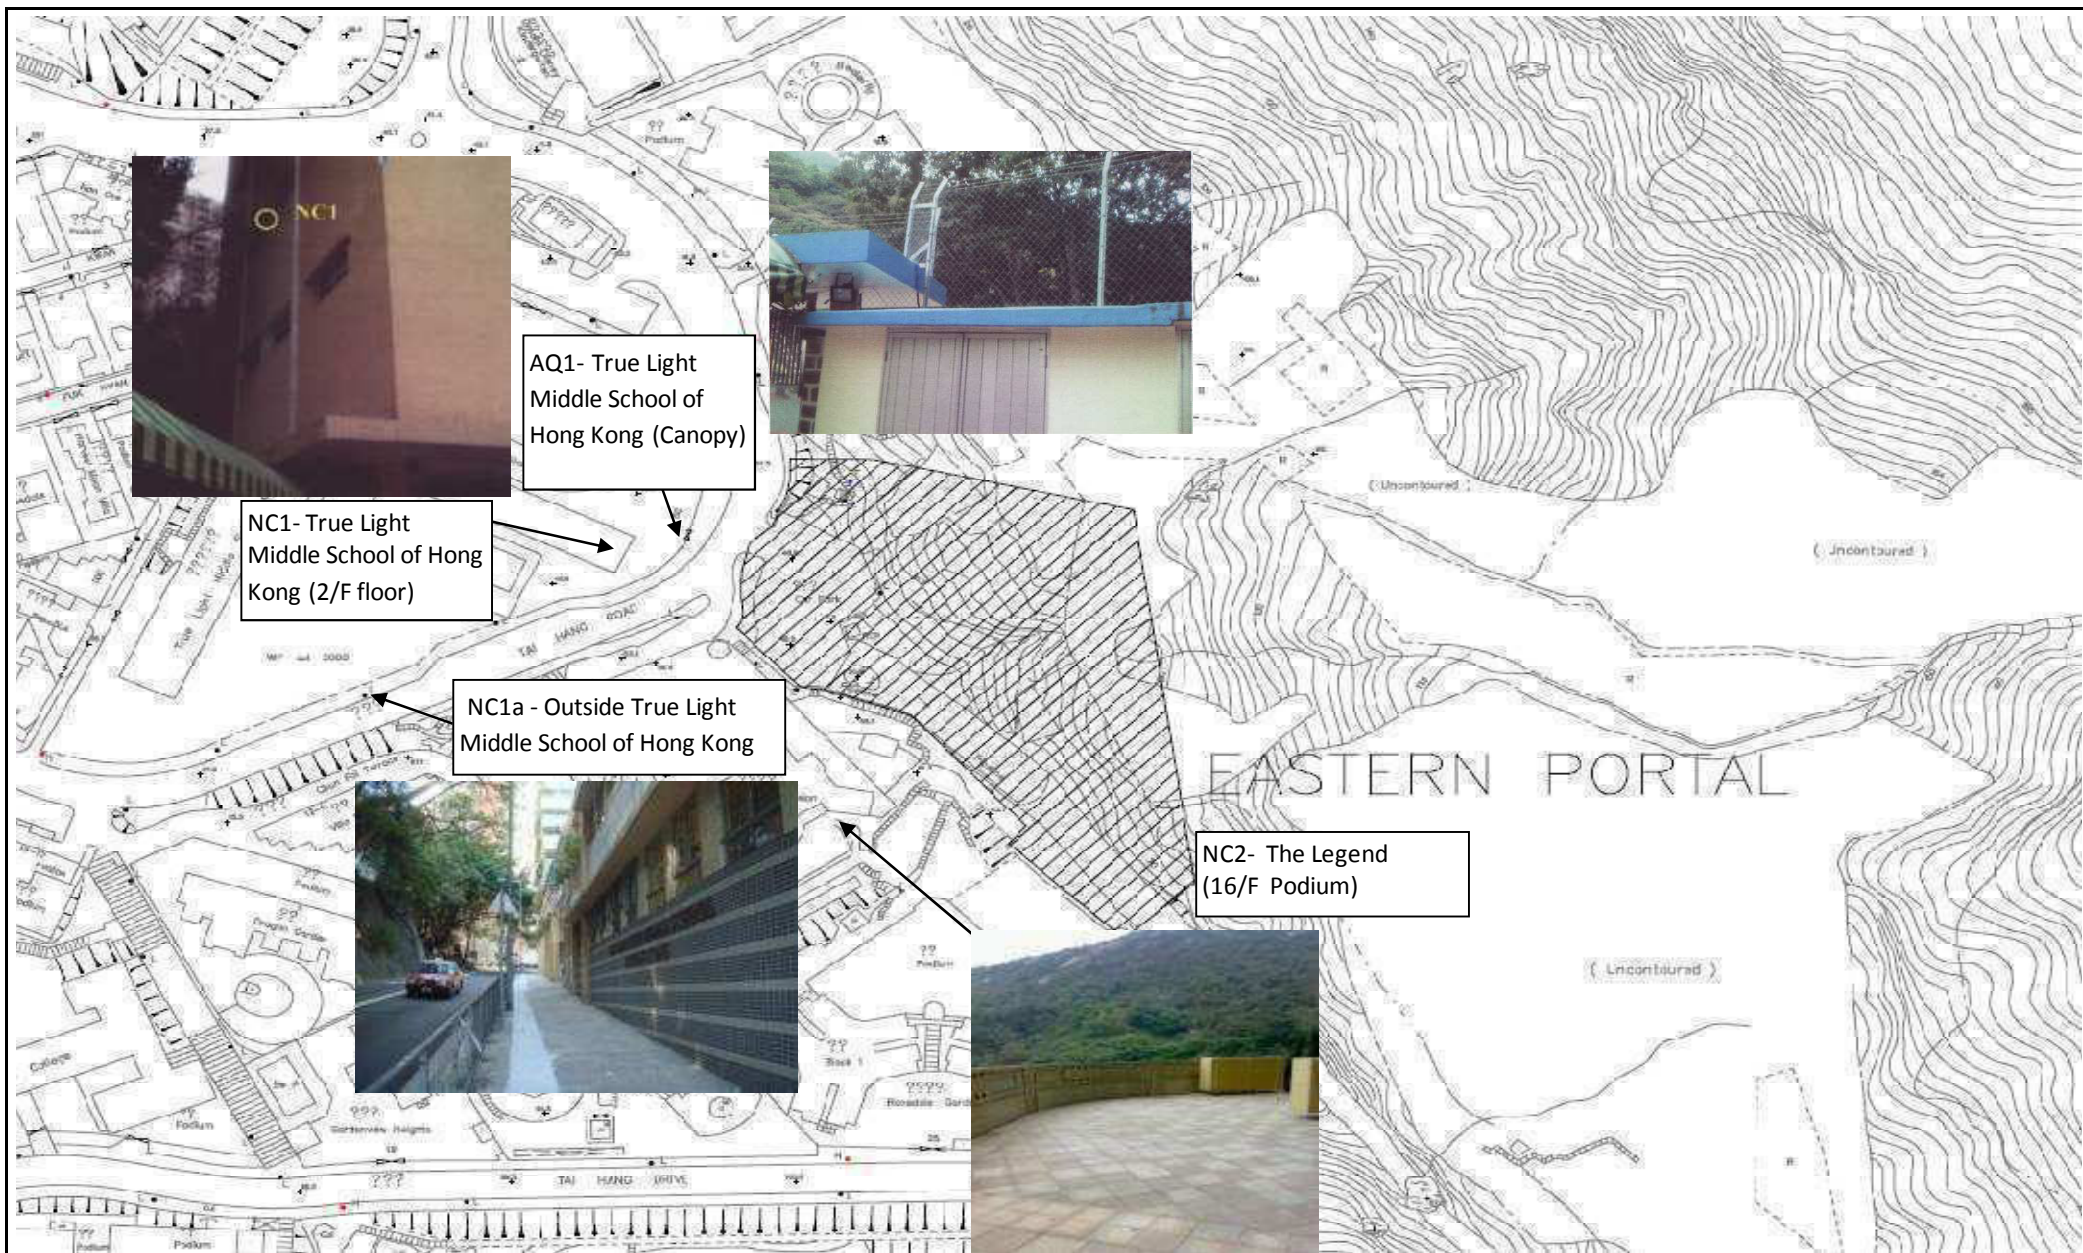

Title

Contract No. DC/2007/10

Design and Construction of Hong Kong West Drainage Tunnel
(Eastern Portal)

Locations of Air Quality and Noise Monitoring Station

Scale

N.T.S

Date

Sep-09


Project

No. MA 8001

Figure

3.1a

CINOTECH

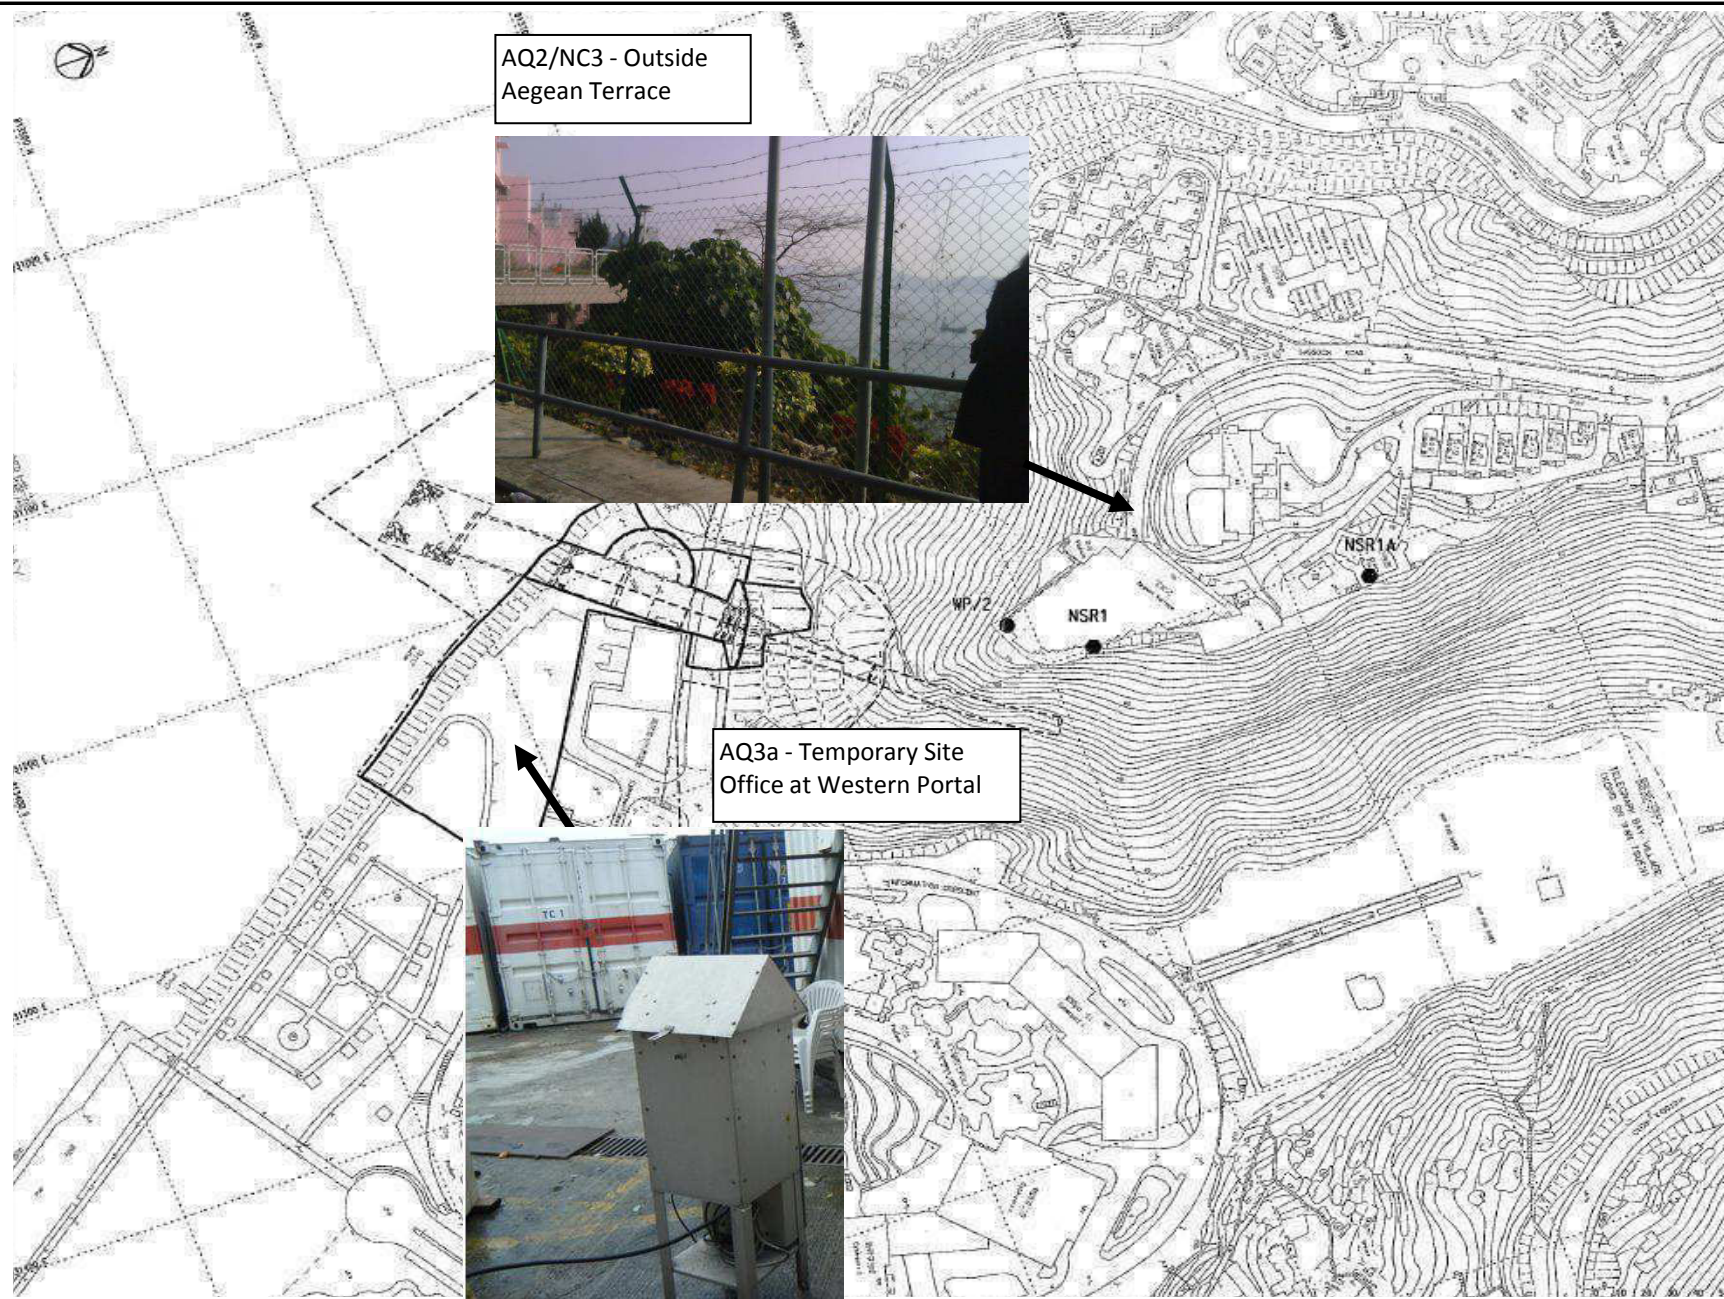

Title

Contract No. DC/2007/10
 Design and Construction of Hong Kong West Drainage Tunnel
 (Western Portal)
 Locations of Air Quality and Noise Monitoring Station

Scale

N.T.S

Date

May-13

Project

No. MA8001


Figure

3.1b

CINOTECH




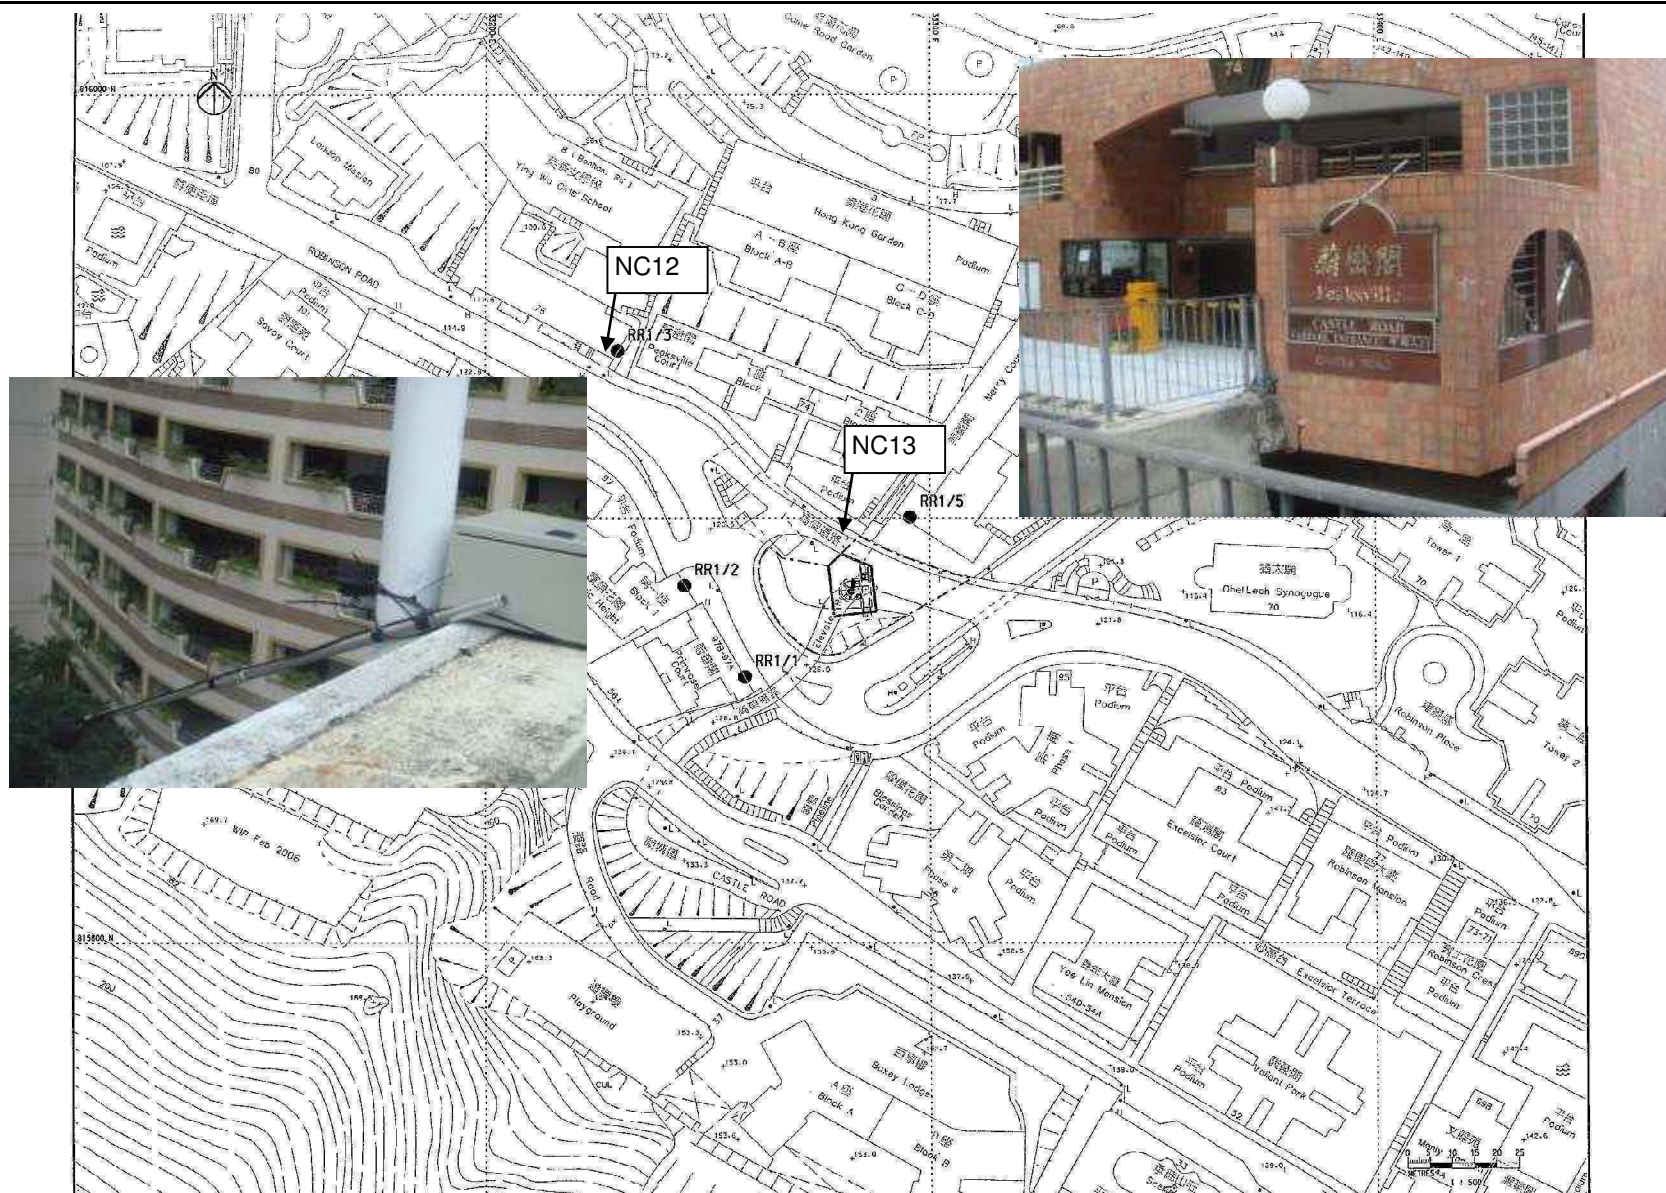
| | | | | |
|--|---|--------|-------|-------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA 8001 |
| | (Intake E7) | | Date | Figure |
| Locations of Noise Monitoring Stations | | Sep-09 | 3.1c | CINOTECH |

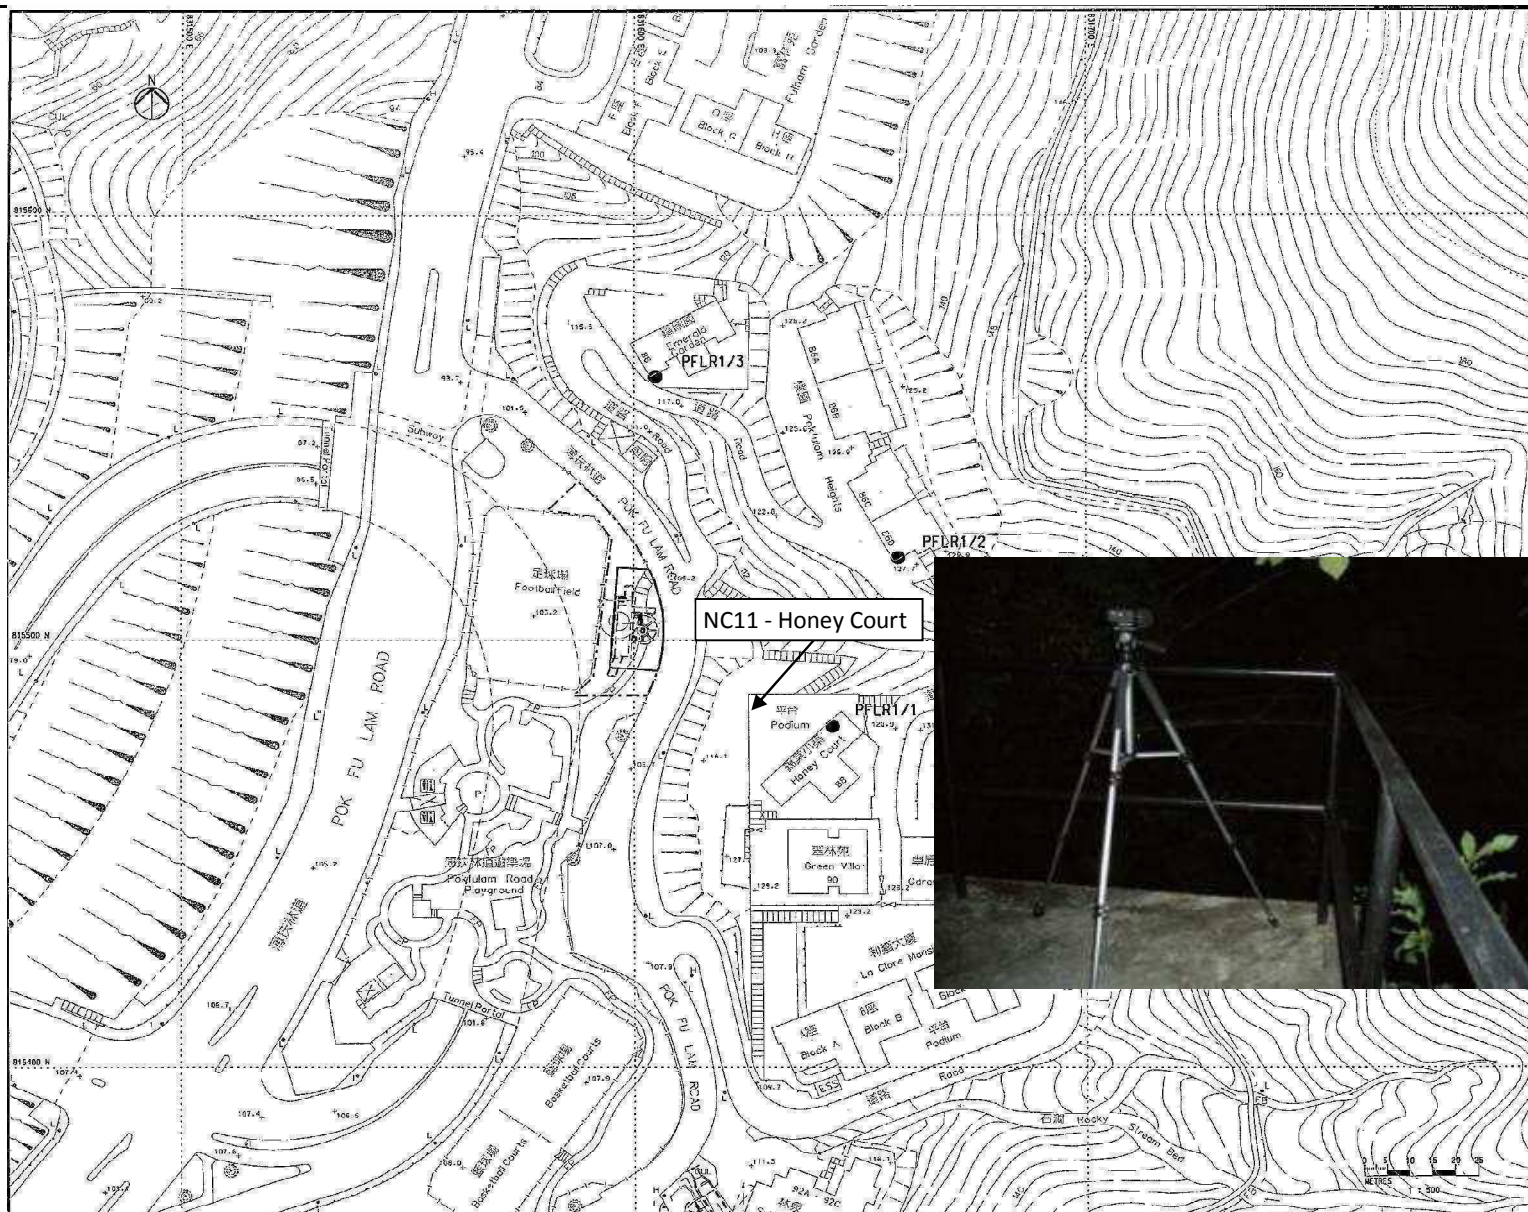


| | | | | |
|--|---|--------|-------|-------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA 8001 |
| | (Intake PFLR1) | | Date | Figure |
| Locations of Noise Monitoring Stations | | Sep-09 | 3.1d | CINOTECH |



| | | | | | |
|--|-------|--------|-------------|---------|---|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel (Intake W0) Locations of Noise Monitoring Stations | Scale | N.T.S | Project No. | MA 8001 |  |
| | Date | Oct-11 | Figure | 3.1e | |



| | | | | |
|--|---|--------|-------|-------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA 8001 |
| | (Intakes RR1) | | Date | Figure |
| Locations of Noise Monitoring Stations | | Jan 10 | 3.1f | CINOTECH |

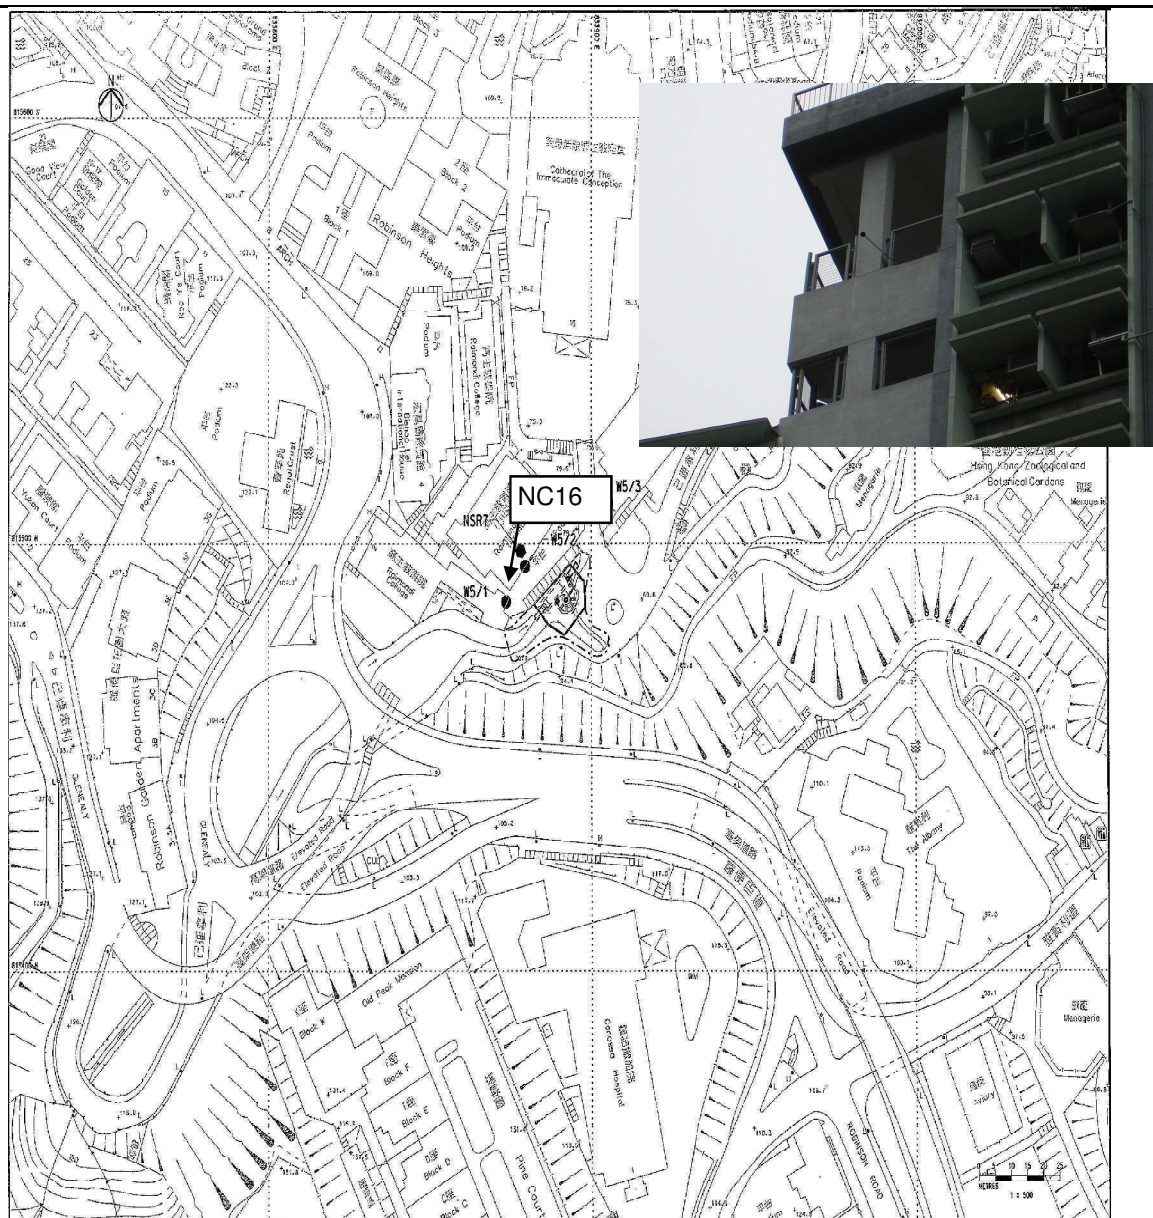

| | | | | | | |
|-------|---|--|--------|---------|--------|----------|
| Title | Contract No. DC/2007/10 | | Scale | Project | | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. | MA8001 | |
| | (Intakes W5) | | Date | Figure | | |
| | Locations of Noise Monitoring Stations | | Jan-10 | 3.1g | | |



| | | | | |
|--|---|--------|-------|-------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA 8001 |
| | (Intakes E5A) | | Date | Figure |
| Locations of Noise Monitoring Stations | | Feb-10 | 3.1h | CINOTECH |




| | | | | |
|--|---|--------|-------|-------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA 8001 |
| | (Intake THR2) | | Date | Figure |
| Locations of Noise Monitoring Stations | | Feb-10 | 3.1i | CINOTECH |



| | | | | |
|--|---|--|--------|------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA8001 |
| | (Intakes P5) | | Date | Figure |
| Locations of Noise Monitoring Stations | | | Feb-10 | 3.1j |

CINOTECH

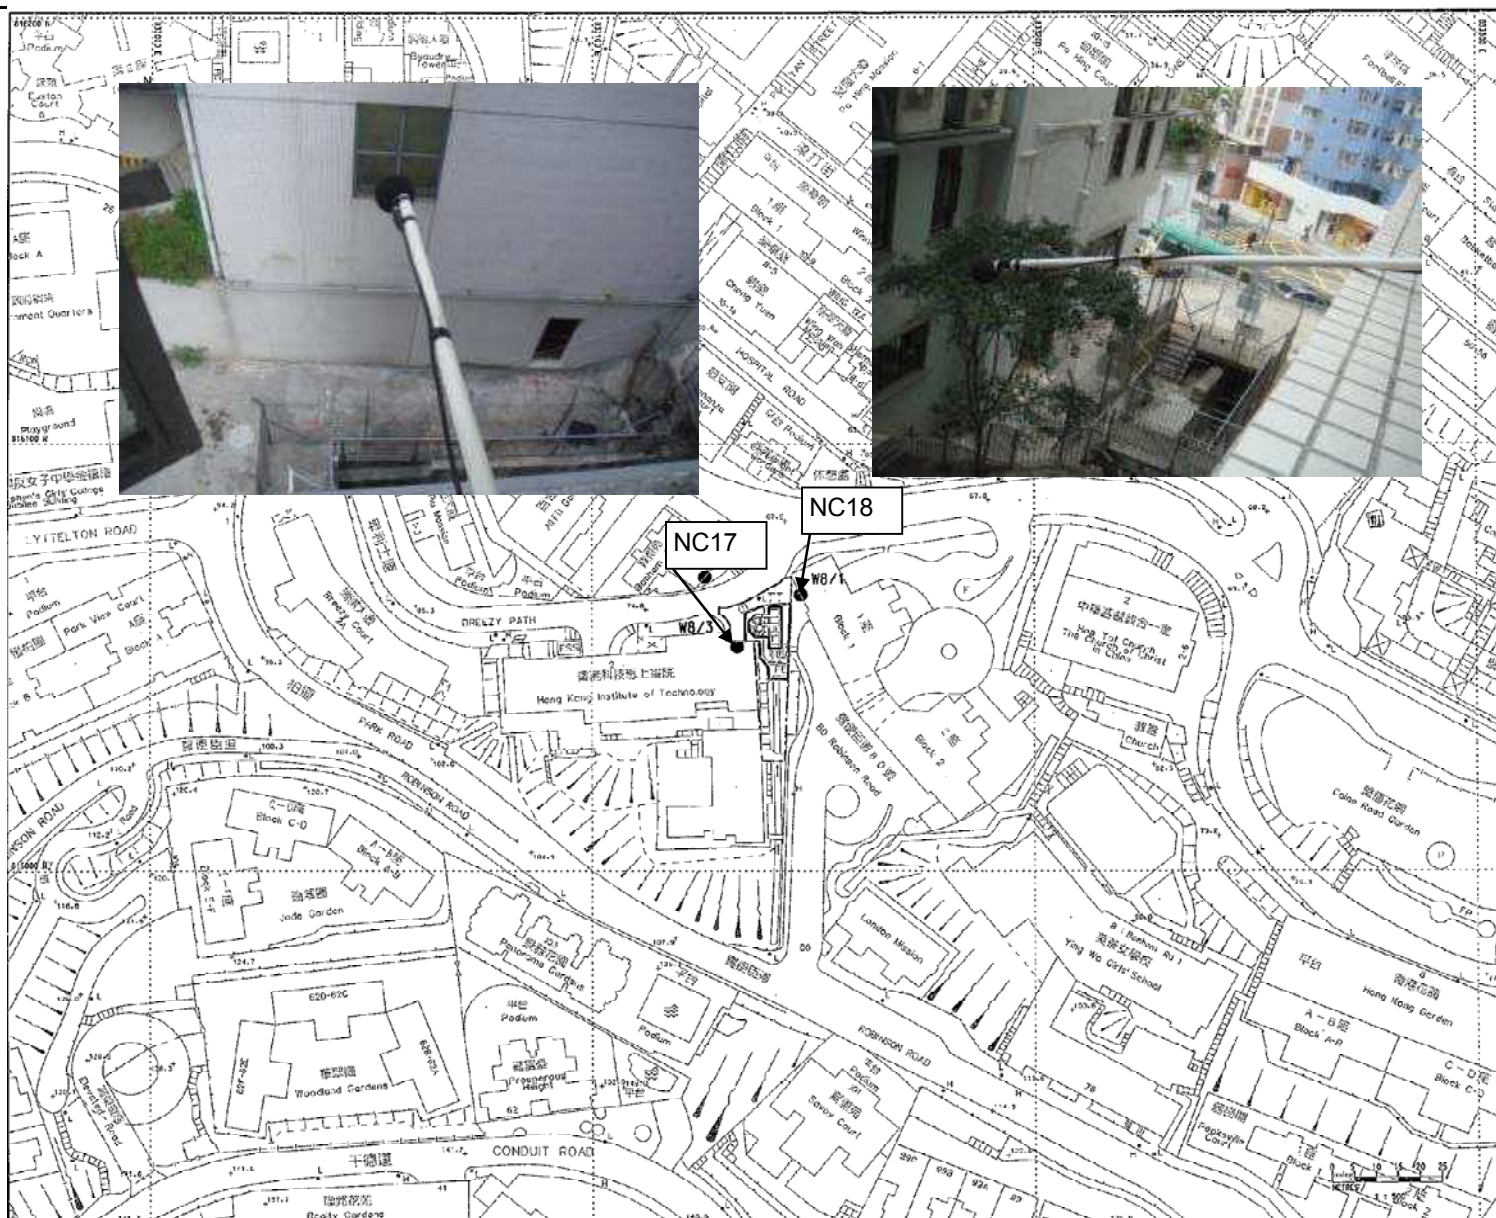

| | | | | | |
|-------|---|--|--------|------------|----------|
| Title | Contract No. DC/2007/10 | | Scale | Project | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA8001 | |
| | (Intake W8) | | Date | Figure | |
| | Locations of Noise Monitoring Stations | | Jun-10 | 3.1k | |

CINOTECH




| | | | | |
|-------|---|--|--------|------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA8001 |
| | (Intake DG1) | | Date | Figure |
| | Locations of Noise Monitoring Stations | | Aug-10 | 3.11 |

CINOTECH




| | | | | |
|-------|---|--|--------|------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA8001 |
| | (Intake MA14) | | Date | Figure |
| | Locations of Noise Monitoring Stations | | Aug-10 | 3.1m |


CINOTECH

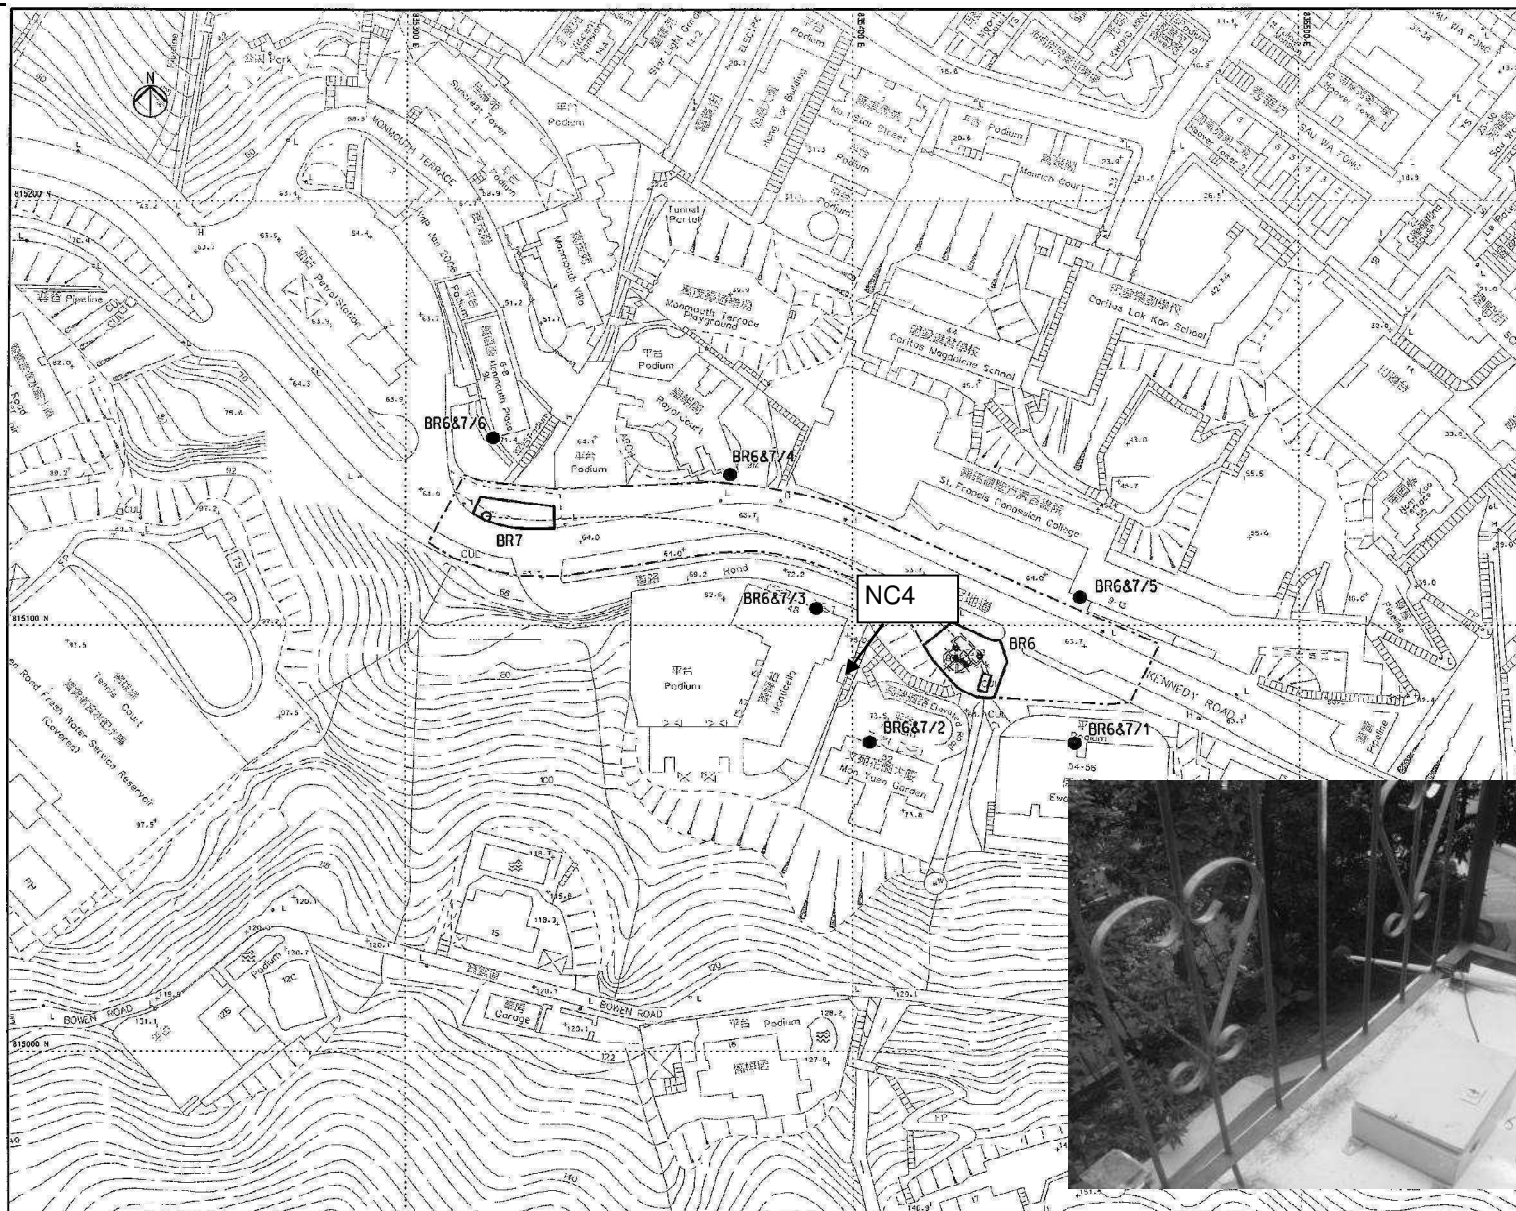


| | | | | |
|--|---|--------|-------|------------|
| Title | Contract No. DC/2007/10 | | Scale | Project |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA8001 |
| | (Intakes BR6) | | Date | Figure |
| Locations of Noise Monitoring Stations | | Sep-10 | 3.1n | CINOTECH |

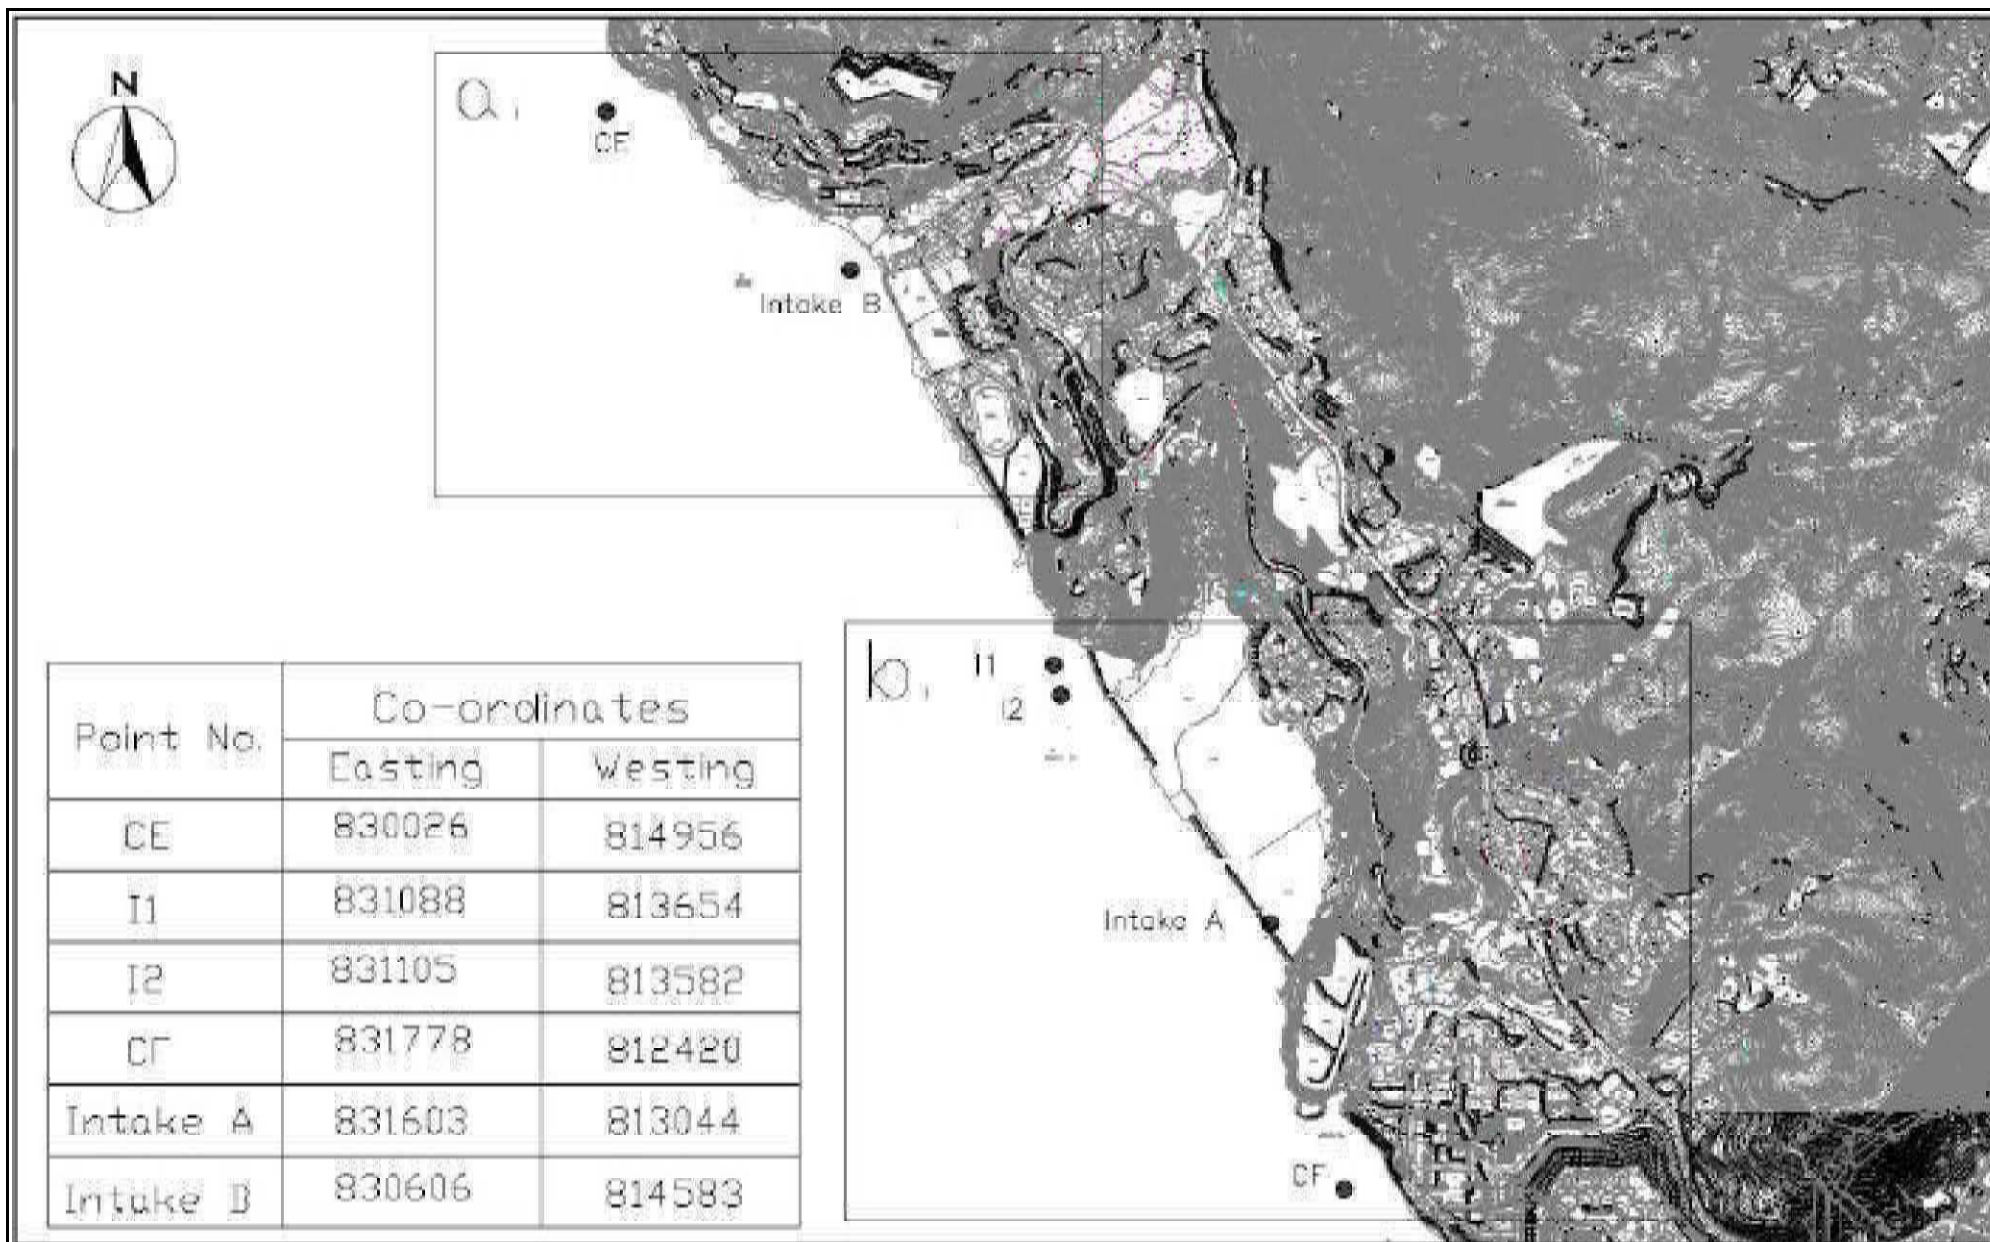

| | | | | |
|-------|--|--------|------------|----------|
| Title | Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Locations of Water Quality Monitoring Stations | Scale | Project | CINOTECH |
| | | N.T.S | No. MA8001 | |
| | | Date | Figure | |
| | | Jun-08 | 4.1 | |

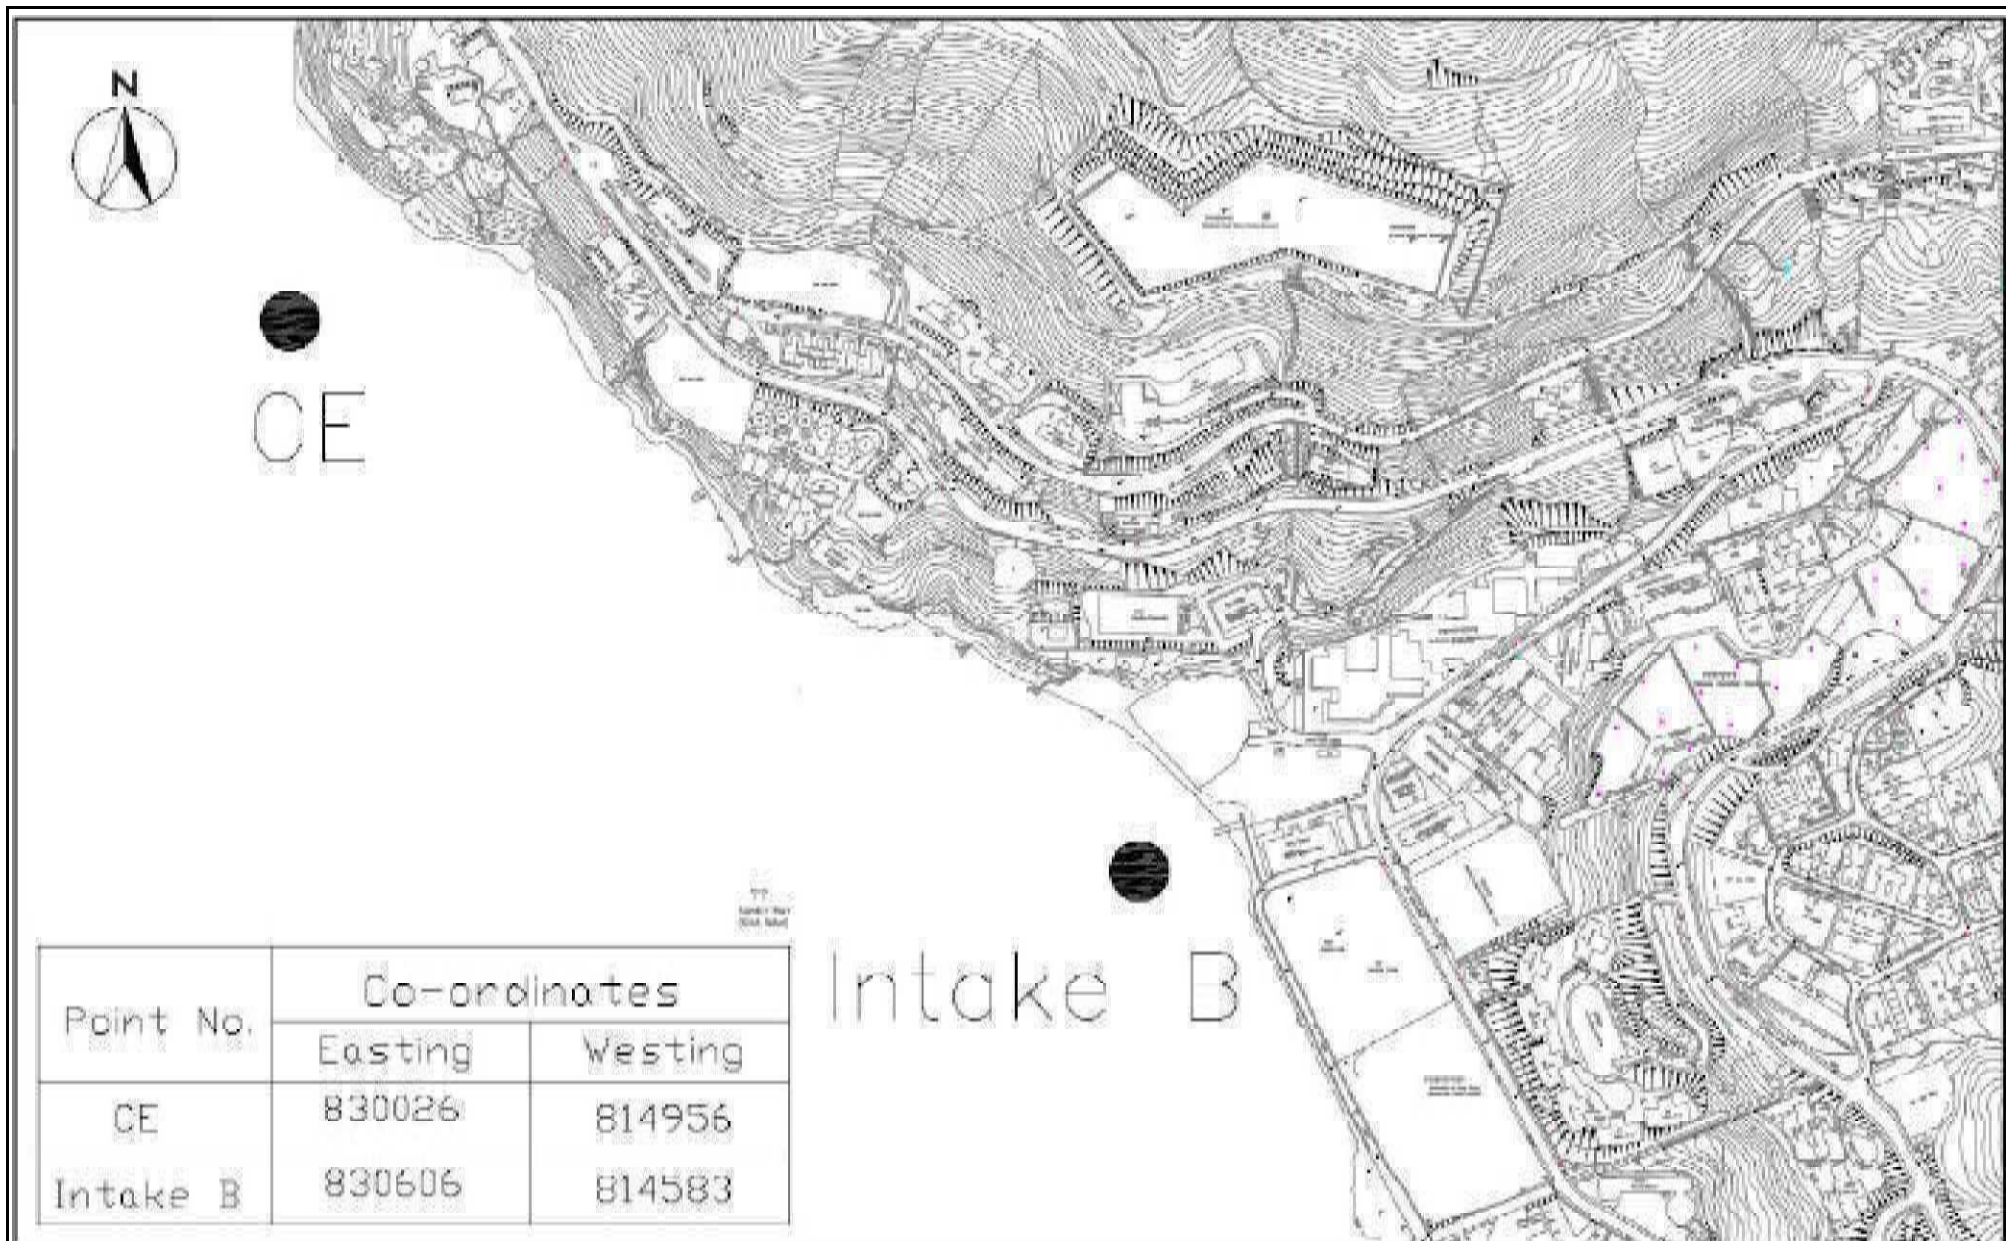

| | | | | |
|-------|--|--------|------------|----------|
| Title | Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Locations of Water Quality Monitoring Stations | Scale | Project | CINOTECH |
| | | N.T.S | No. MA8001 | |
| | | Date | Figure | |
| | | Jun-08 | 4.1a | |

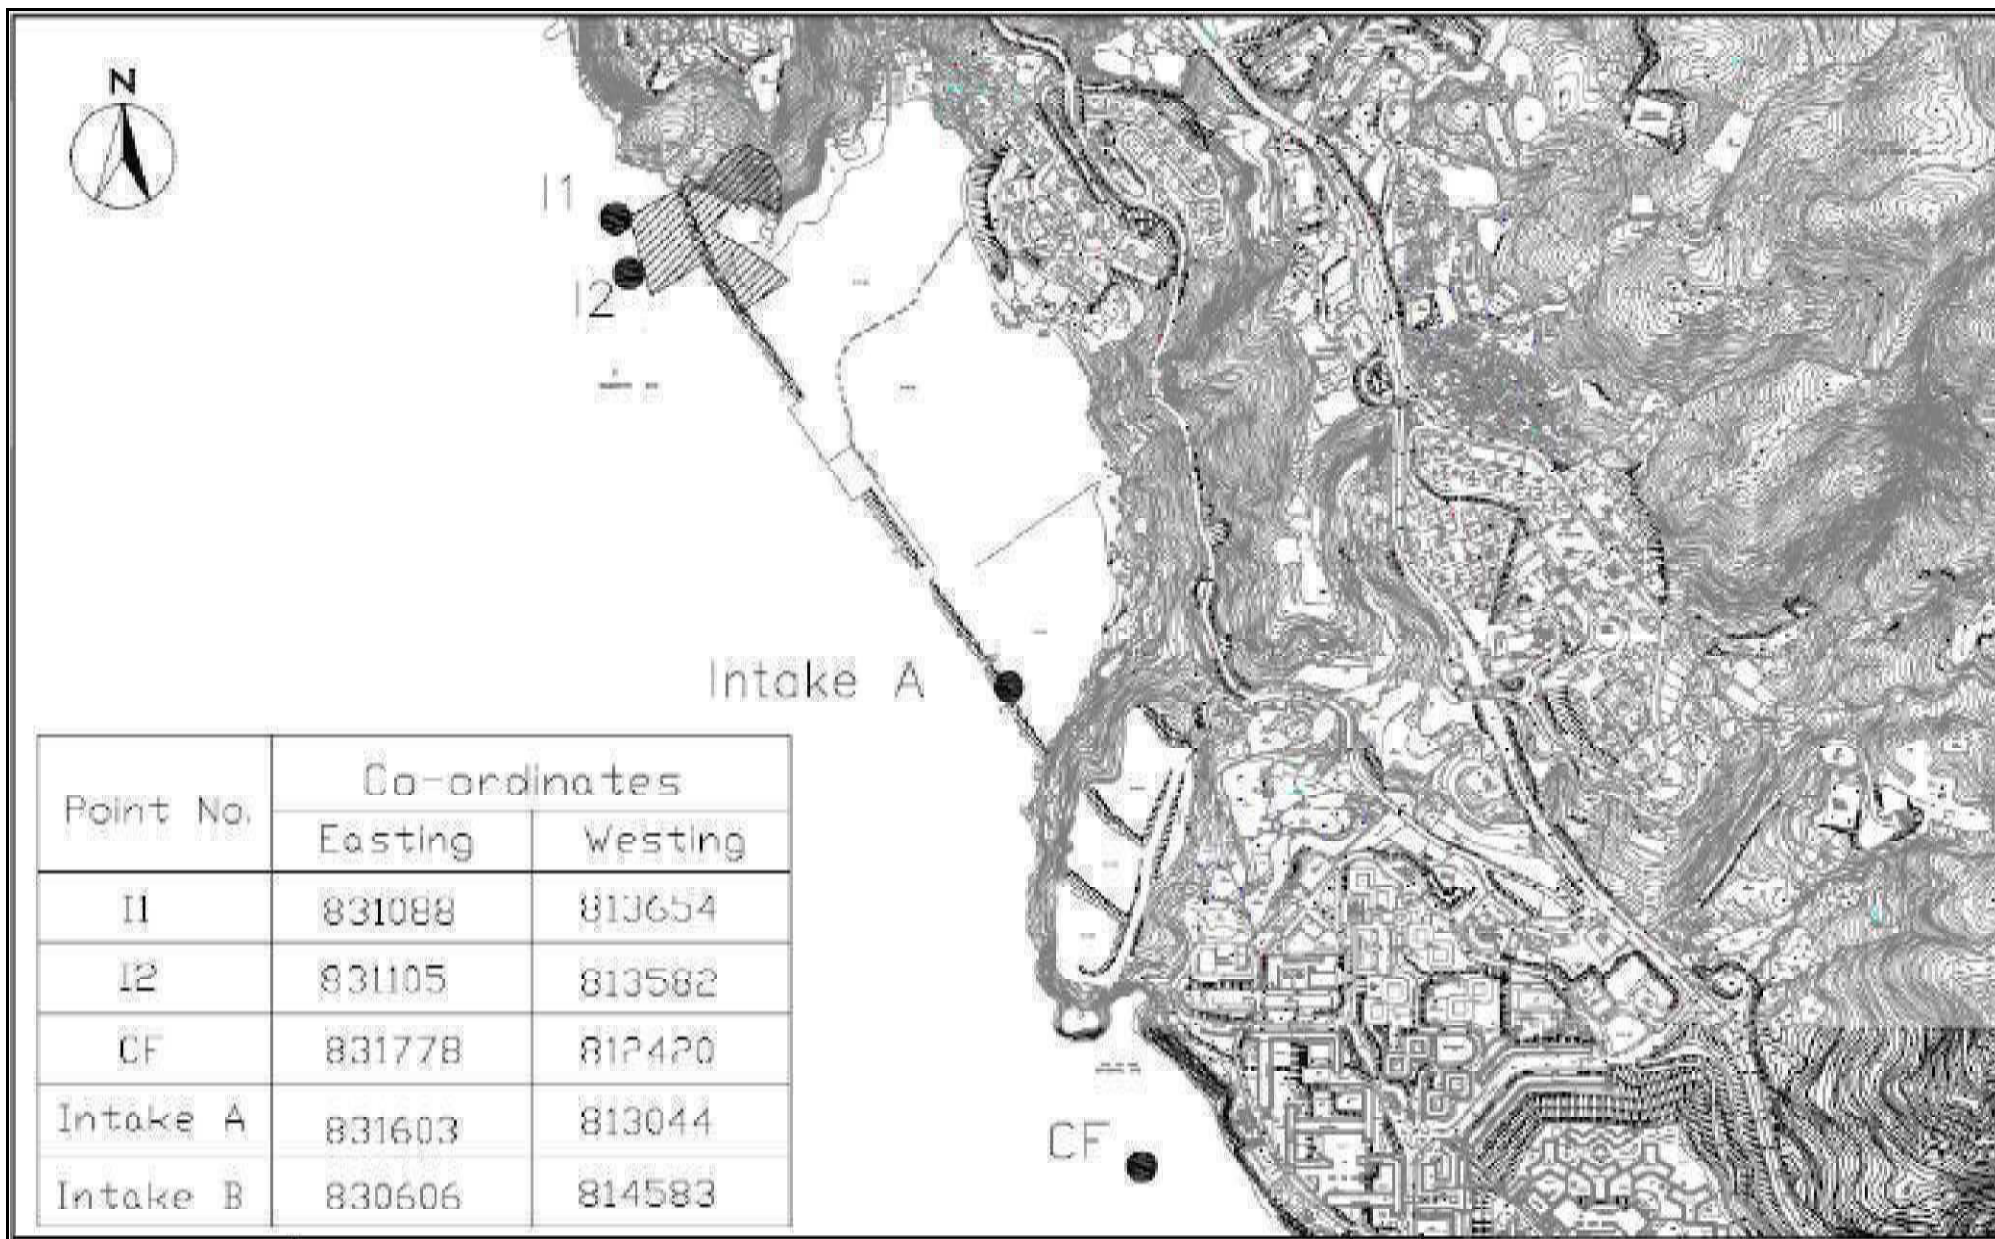


| | | | | |
|-------|--|--------|------------|----------|
| Title | Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Locations of Water Quality Monitoring Stations | Scale | Project | CINOTECH |
| | | N.T.S | No. MA8001 | |
| | | Date | Figure | |
| | | Jun-08 | 4.1b | |




Legend:
 ● Ground Water Monitoring Station
 ■ Notional Area for Storage of Equipment and Works Area


| | | | | | |
|-------|---|--|--------|------------|----------|
| Title | Contract No. DC/2007/10 | | Scale | Project | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel (Eastern Portal) | | N.T.S | No. MA8001 | |
| | Location of ground water level Monitoring Station | | Date | Figure | |
| | | | Mar-10 | 4.2a | |

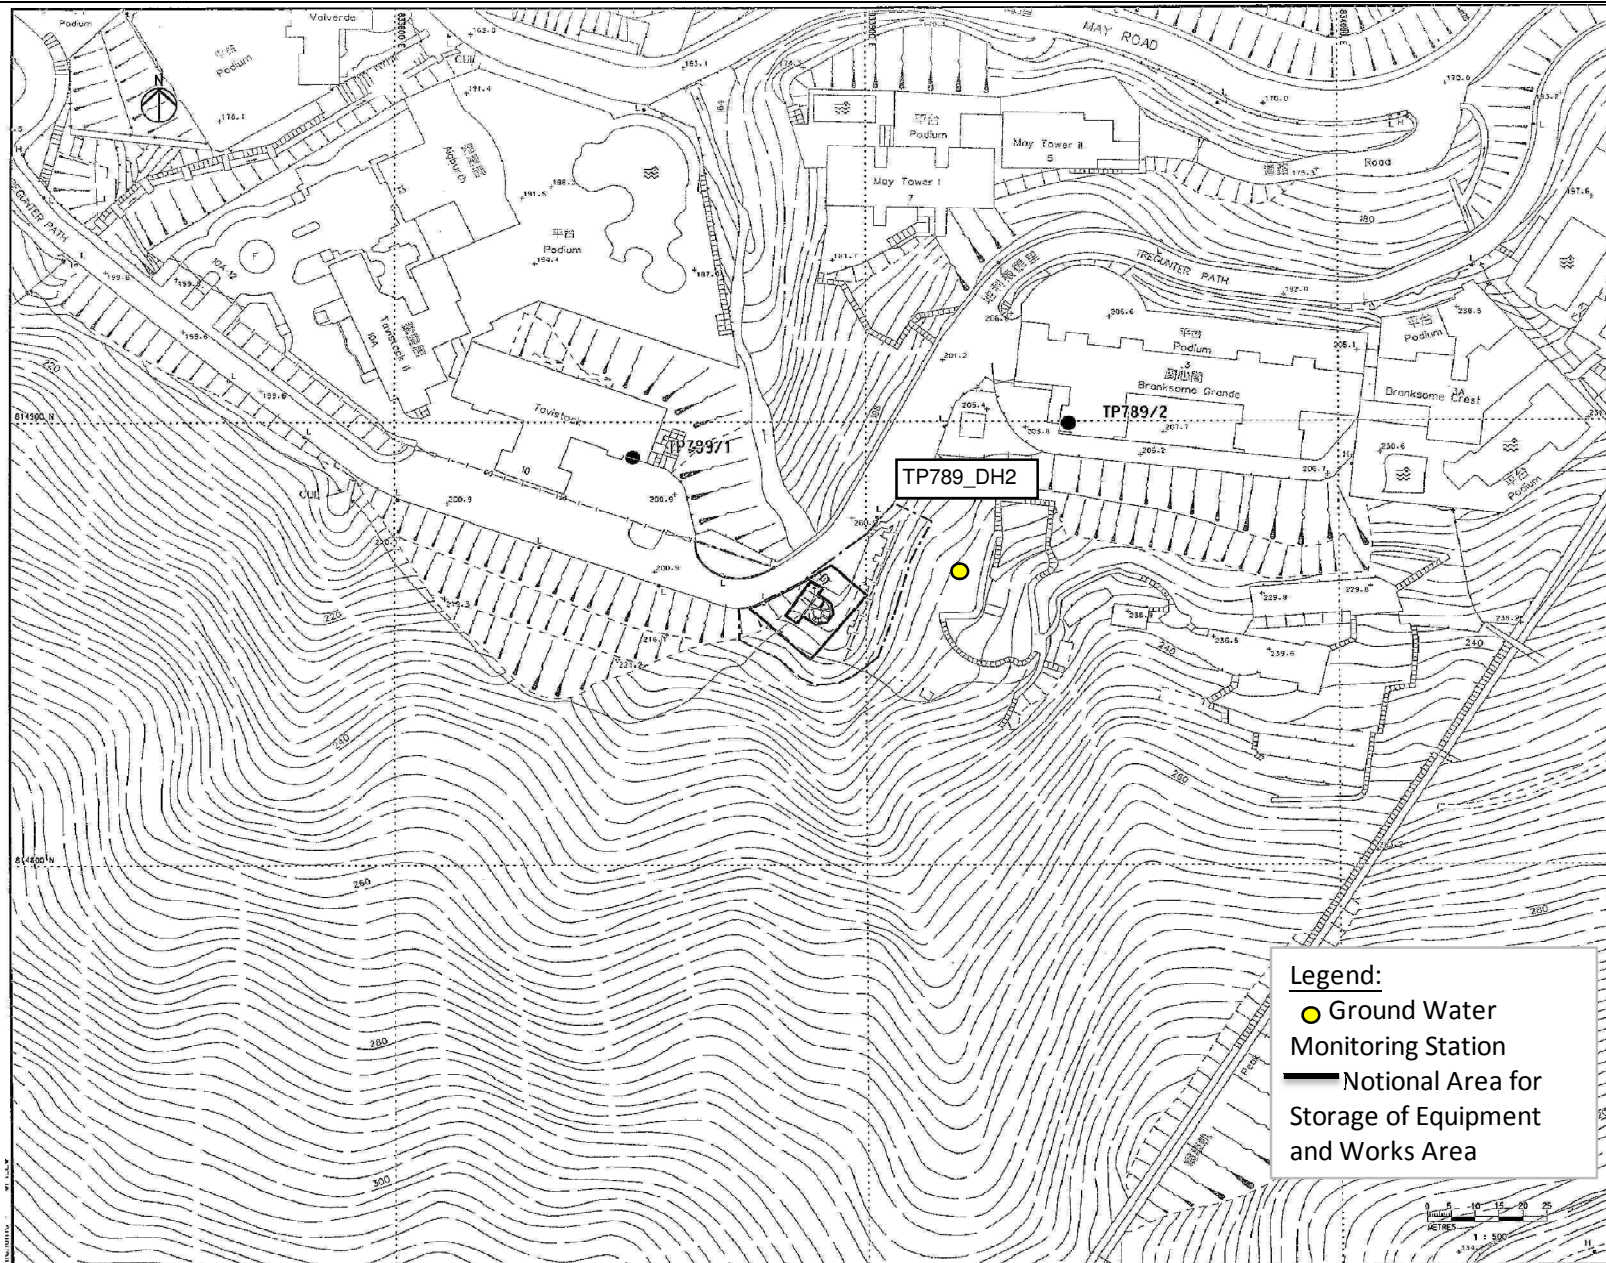


| | | | | |
|-------|---|--------|------------|----------|
| Title | Contract No. DC/2007/10 | Scale | Project | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | N.T.S | No. MA8001 | |
| | (Intake TP789) | Date | Figure | |
| | Location of ground water level Monitoring Station | Mar-10 | 4.2b | |

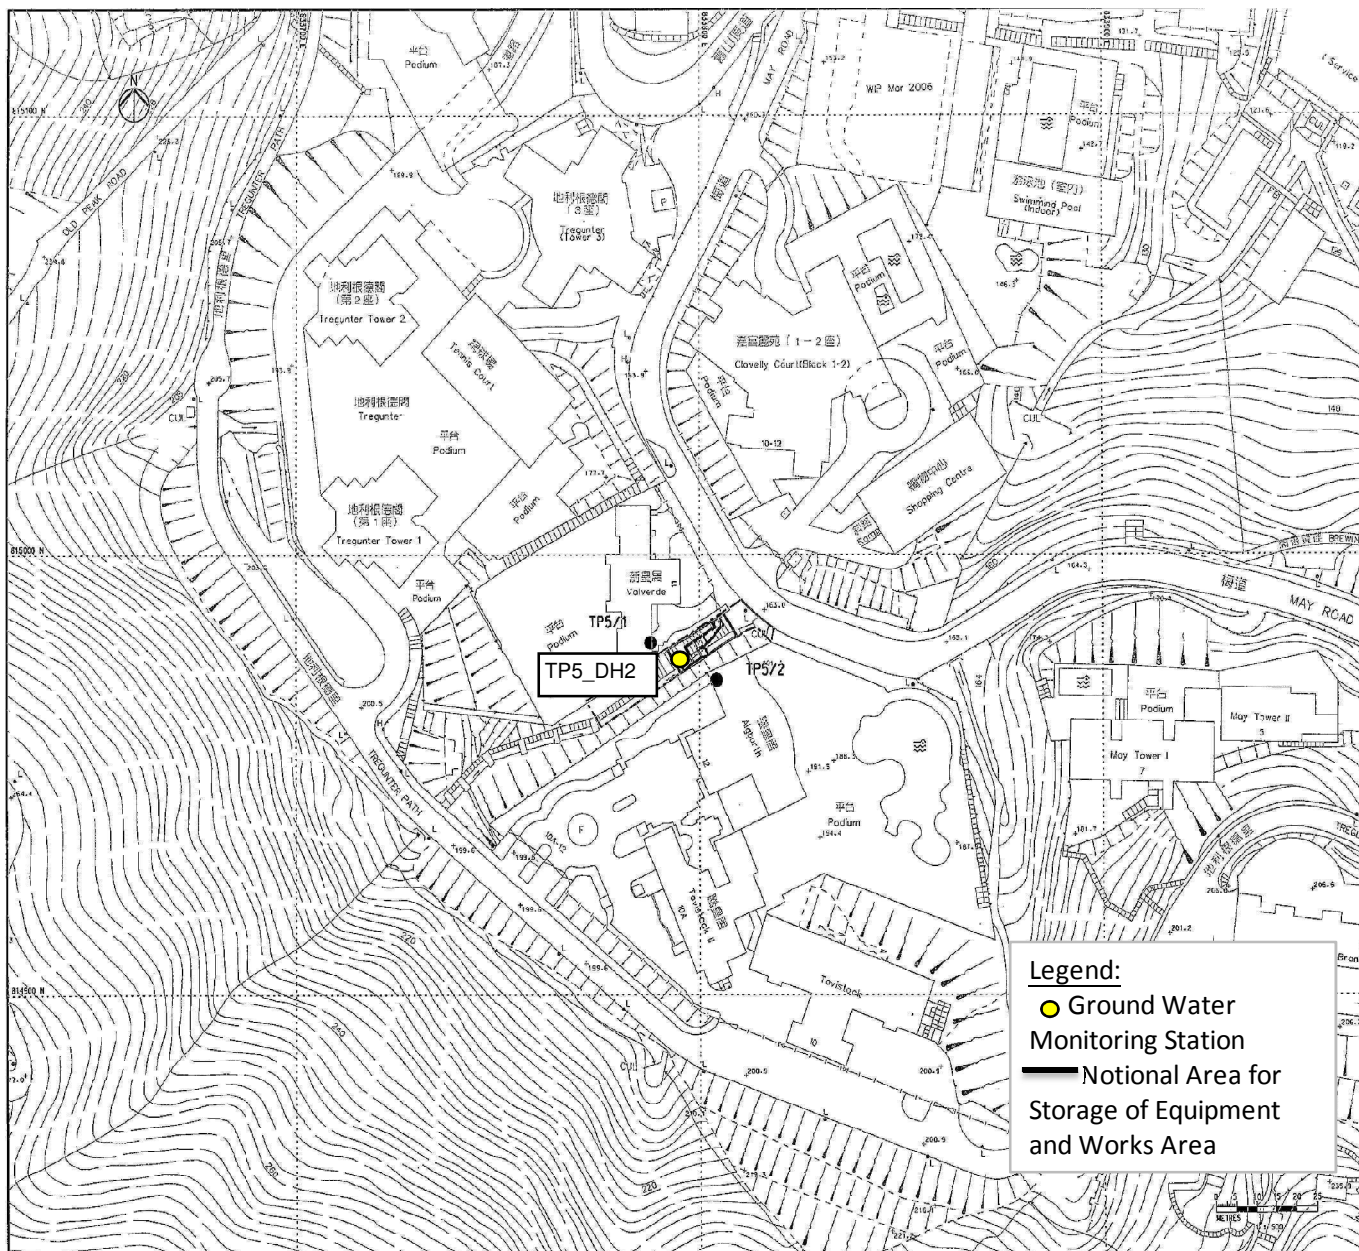

| | | | | |
|-------|---|--------|------------|----------|
| Title | Contract No. DC/2007/10 | Scale | Project | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | N.T.S | No. MA8001 | |
| | (Intake TP5) | Date | Figure | |
| | Location of ground water level Monitoring Station | Mar-10 | 4.2c | |

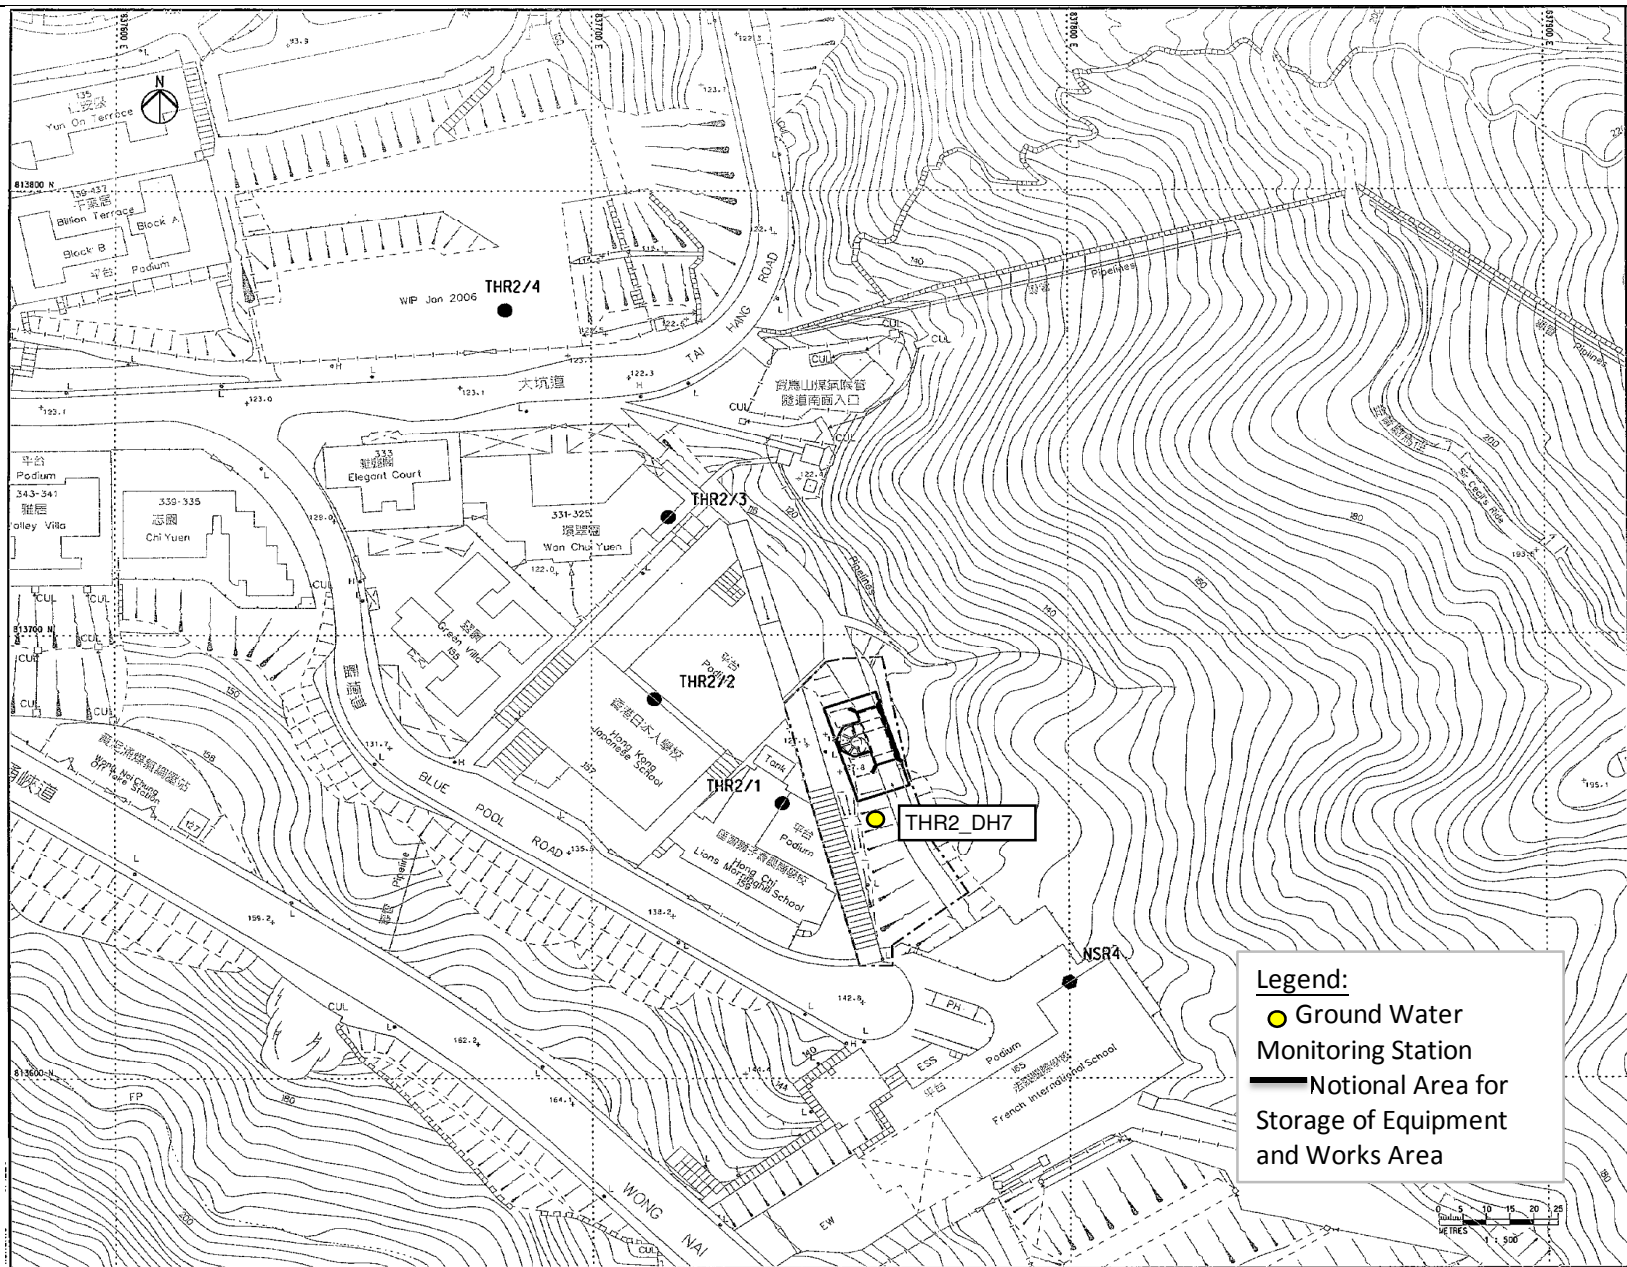

| | | | | |
|-------|---|--------|------------|----------|
| Title | Contract No. DC/2007/10 | Scale | Project | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | N.T.S | No. MA8001 | |
| | (Intake THR2) | Date | Figure | |
| | Location of ground water level Monitoring Station | Mar-10 | 4.2d | |

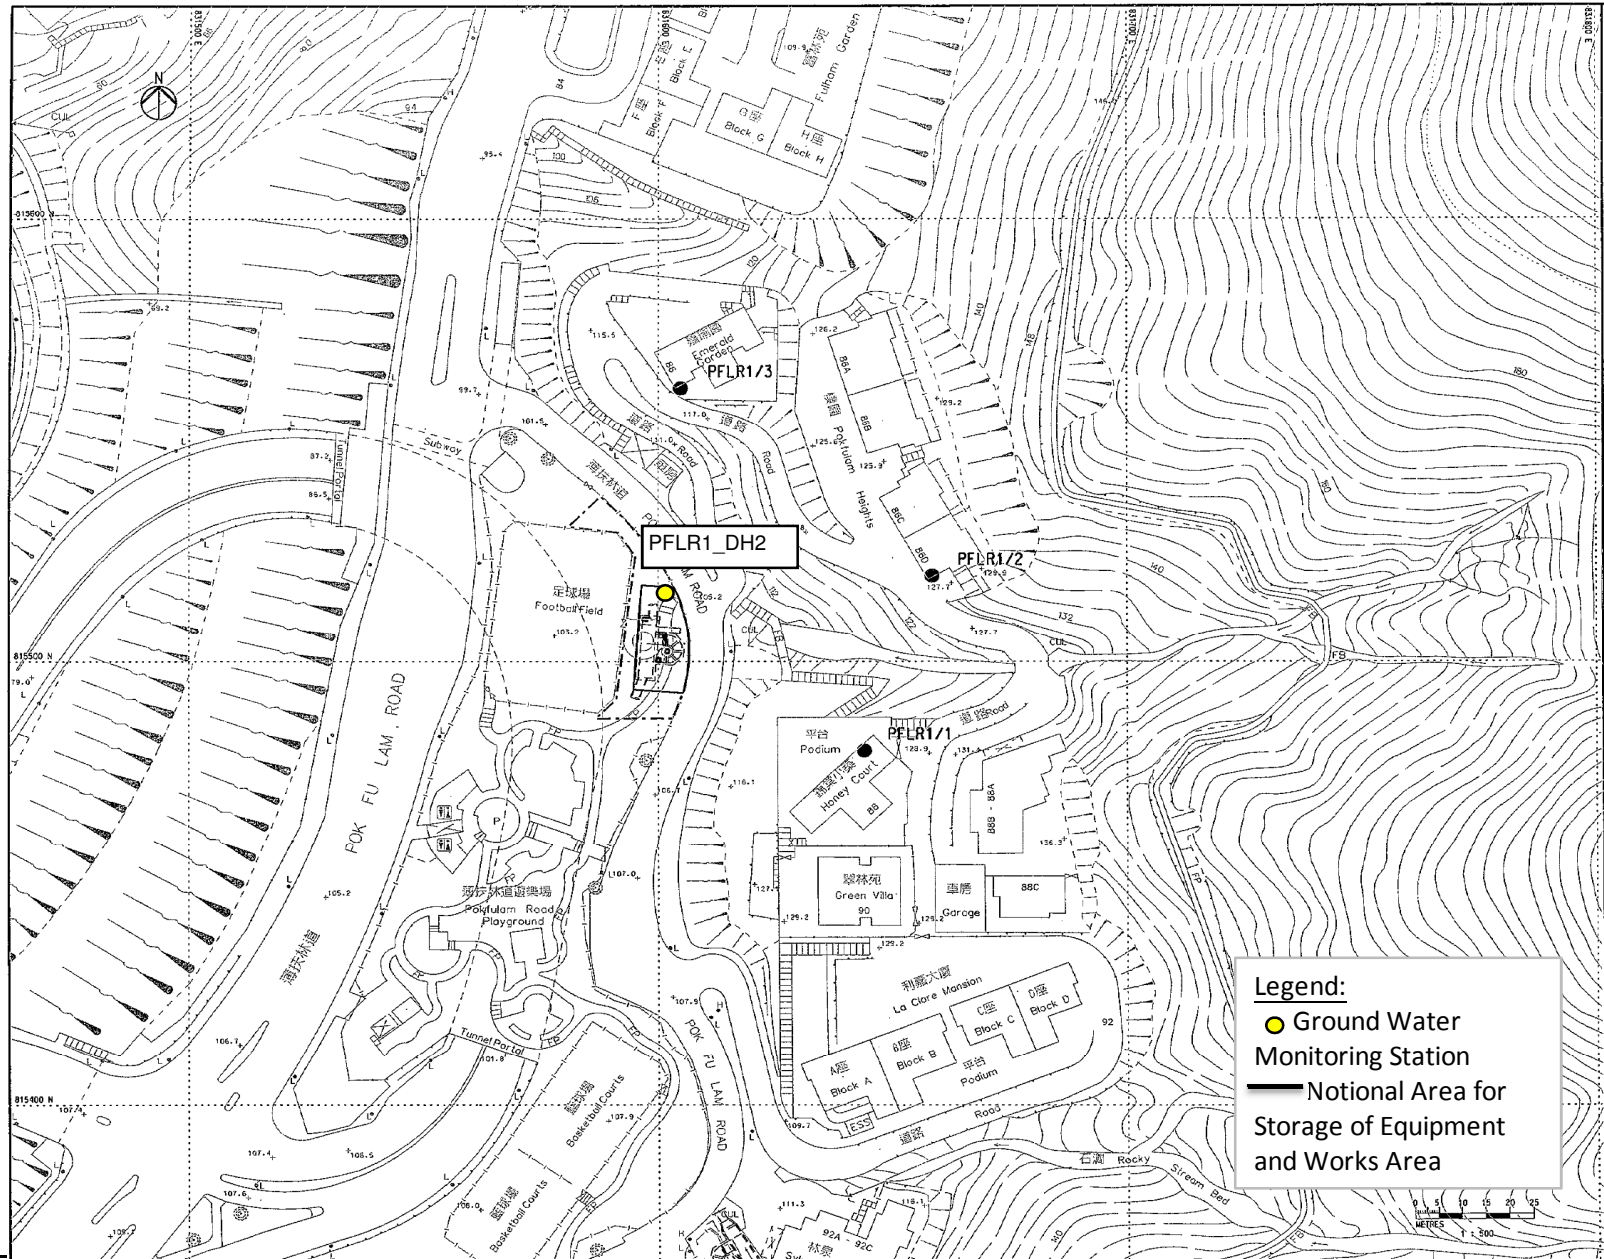

| | | | | | | |
|-------|---|--|--------|------------|--|----------|
| Title | Contract No. DC/2007/10 | | Scale | Project | | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | | N.T.S | No. MA8001 | | |
| | (Intake PFLR1) | | Date | Figure | | |
| | Location of ground water level Monitoring Station | | Mar-10 | 4.2e | | |

APPENDIX A
CONSTRUCTION PROGRAMME

Major Site Activities in the Next 2 Months

[illegible]

APPENDIX B
MONITORING REQUIREMENTS

Appendix B - Environmental Impact Monitoring Requirements

| Type of Monitoring | Parameter | Frequency | Location | Measurement Conditions |
|--------------------|-------------|----------------------|--|---|
| Air Quality | 1 hour TSP | Three times / 6 days | <ul style="list-style-type: none"> • AQ1 (True Light Middle School of Hong Kong) • AQ2 (Outside Aegean Terrace) | AQ1 – Canopy AQ2 – Roadside AQ3 – Roadside AQ3a – Roadside |
| | 24 hour TSP | Once / 6 days | <ul style="list-style-type: none"> • AQ1 (True Light Middle School of Hong Kong) • AQ3 (Outside Site Office at Western Portal) • AQ3a (Temporary Site Office at Western Portal) | |

| Type of Monitoring | Parameter | Frequency | Location | Measurement Conditions |
|--------------------|--|---------------|---|---|
| Airborne Noise | L_{eq} , L_{90} & L_{10} at 30 minute intervals during (0700 to 1900 on normal weekdays) | Once per week | <ul style="list-style-type: none"> • NC1 (True Light Middle School of Hong Kong) • NC2 (The Legend) • NC3 (Outside Aegean Terrace) • NC4 (Man Yuen Garden) – completed in mid November 2012 • NC5 (Blk D Villa Monte Rosa) • NC6 (Rosaryhill School) • NC7 (Buddist Li Ka Shing Care & Attention Home for the Elderly) • NC8 (Marymount Secondary School) • NC9 (117 Blue Pool Road) • NC10 (The Harbour View) – completed in mid November 2012 • NC11 (Honey Court) • NC12 (Ying Wa Girl's School) • NC13 (Peaksville Court) • NC15a (12 Tung Shan Terrace) • NC16 (Raimondi College) • NC17 (Hong Kong Institute of | <ul style="list-style-type: none"> • NC1 - Facade measurement • NC2 - Facade measurement • NC3 - Facade measurement • NC4 - Facade measurement • NC5 - Free field measurement • NC6 - Facade measurement • NC7 - Facade measurement • NC8 – Facade measurement • NC9 – Facade measurement • NC10 – Facade measurement |

| Type of Monitoring | Parameter | Frequency | Location | Measurement Conditions |
|--------------------|-----------|-----------|--|---|
| | | | Technology) • NC18 (Blk A, 80 Robinson Road) • NC19 (Villa Veneto) | <ul style="list-style-type: none"> • NC11 – Free field measurement • NC12 - Facade measurement • NC13 - Facade measurement • NC15a – Facade measurement • NC16 - Facade measurement • NC17- Facade measurement • NC18- Facade measurement • NC19 - Facade measurement |

Remarks:

⁽¹⁾ – Conduct noise monitoring only when construction work is carried out.

| Type of Monitoring | Parameter | Frequency | Location | Measurement Conditions |
|--------------------|---|----------------------|--|--|
| Water Quality | <ul style="list-style-type: none"> • Temperature (oC) • pH (pH unit) • Turbidity (NTU) • Water depth (m) • Salinity (mg/L) • Dissolved oxygen (DO) (mg/L and % of saturation) • Suspended solids (SS) (mg/L) | Three times per week | <ul style="list-style-type: none"> • CE (830026E, 814956N) • CF (831778E, 812420N) • I1 (831088E, 813654N) • I2 (831105E, 813582N) • Intake A (831603E, 813044N) • Intake B (830606E, 814583N) | <ul style="list-style-type: none"> • 3 water depths except CF, omit mid-depth sampling. |

APPENDIX C
ACTION AND LIMIT LEVELS FOR AIR
QUALITY, NOISE AND WAER QUALITY

Appendix C - Action and Limit Levels

Table C-1 Action and Limit Levels for 1-Hour TSP

| Location | Action Level, $\mu\text{g}/\text{m}^3$ | Limit Level, $\mu\text{g}/\text{m}^3$ |
|----------|--|---------------------------------------|
| AQ1 | 345 | 500 |
| AQ2 | 321 | |

Table C-2 Action and Limit Levels for 24-Hour TSP

| Location | Action Level, $\mu\text{g}/\text{m}^3$ | Limit Level, $\mu\text{g}/\text{m}^3$ |
|----------|--|---------------------------------------|
| AQ1 | 201 | 260 |
| AQ3 | 156 | |

Table C-3 Action and Limit Levels for Construction Noise

| Time Period | Action Level | Limit Level |
|--|---|------------------|
| 0700-1900 hrs on normal weekdays | When one documented complaint is received | 75* dB(A) |
| 0700-2300 hrs on holidays; and 1900-2300 hrs on all other days | | 60/65/70** dB(A) |
| 2300-0700 hrs of next day | | 45/50/55** dB(A) |

(*) reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods.



(**) to be selected based on Area Sensitivity Rating.

Table C-4 Action and Limit Levels for Water Quality

| Parameter | | Action | Limit |
|----------------|--------------------|--|--|
| DO, mg/L | Surface and Middle | 6.3 | 6.2 |
| | Bottom | 6.0 | 5.8 |
| SS, mg/L | | 15.7 or 120% of upstream control station's SS at the same tide of the same day | 16.4 or 130% of SS readings at the upstream control station at the same tide of same day and specific sensitive receiver water quality requirements |
| Turbidity, NTU | | 10.2 or 120% of upstream control station's turbidity at the same tide of the same day | 11.1 or 130% of turbidity at the upstream control station at the same tide of same day |




APPENDIX D
GRAPHICAL PRESENTATION OF AIR
QUALITY MONITORING RESULTS

1-hr TSP Concentration Levels

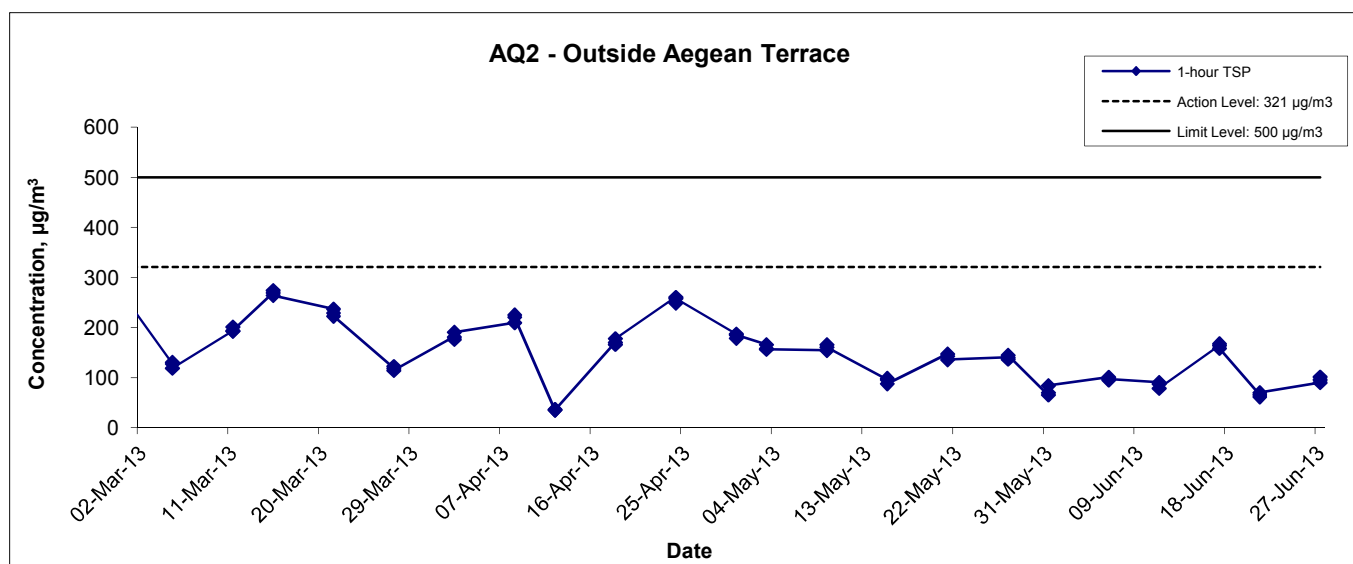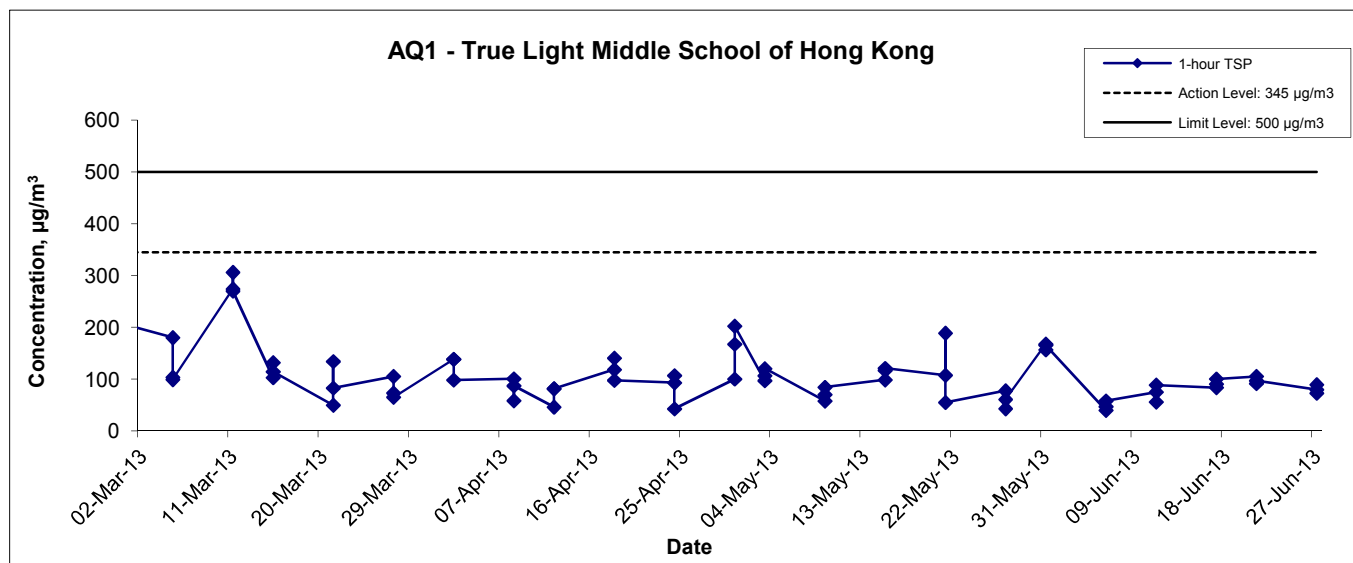

| | | | |
|---|-----------------------|------------------------------|--|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of 1-hour TSP Monitoring Results | Scale N.T.S | Project No. MA8001 | |
| | Date Jun 13 | Appendix D | |




24-hr TSP Concentration Levels

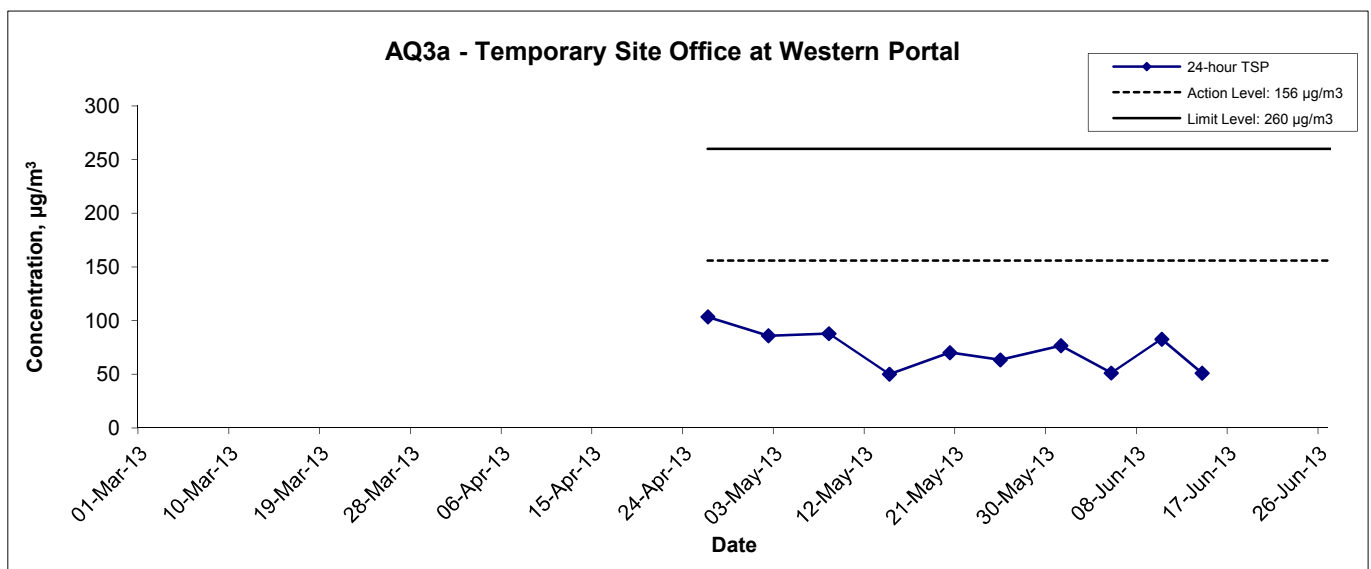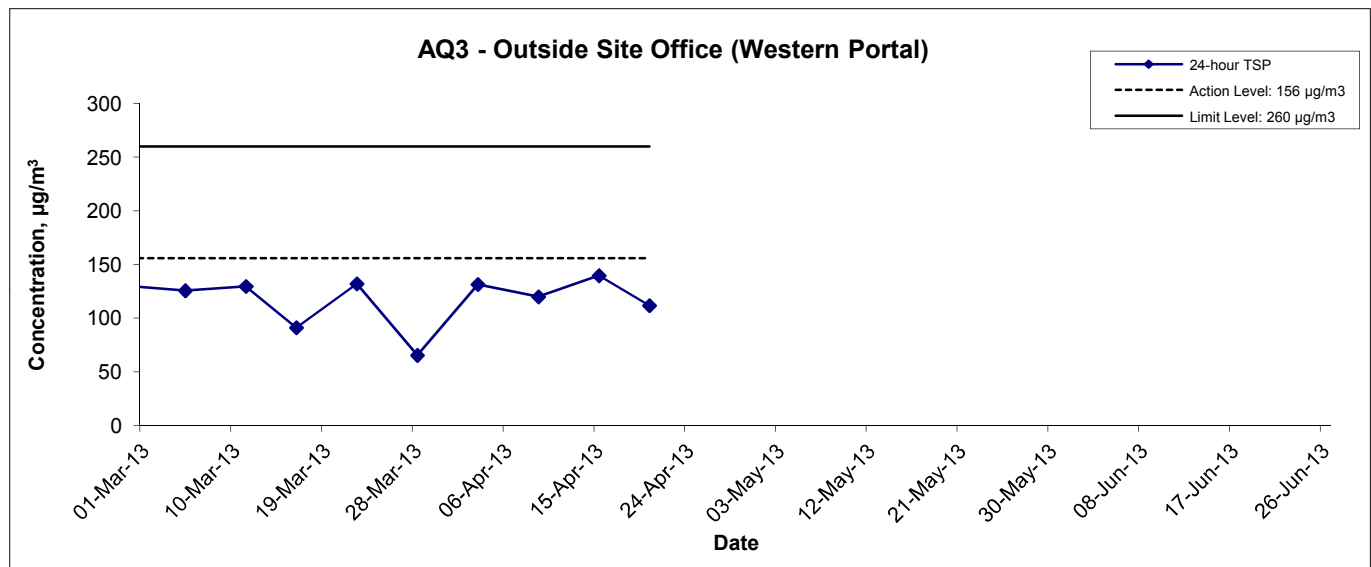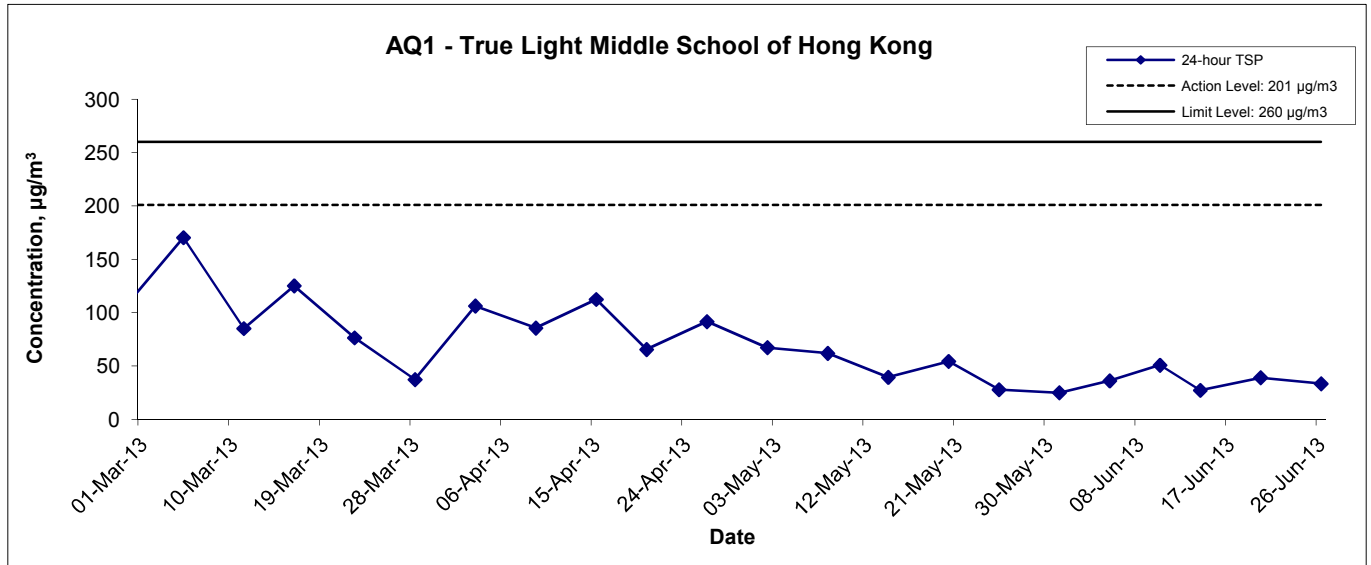

| | | | |
|--|-----------------------|------------------------------|--|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of 24-hour TSP Monitoring Results | Scale N.T.S | Project No. MA8001 | |
| | Date Jun 13 | Appendix D | |
| | | | |




APPENDIX E
GRAPHICAL PRESENTATION OF
NOISE MONITORING RESULTS

Noise Levels

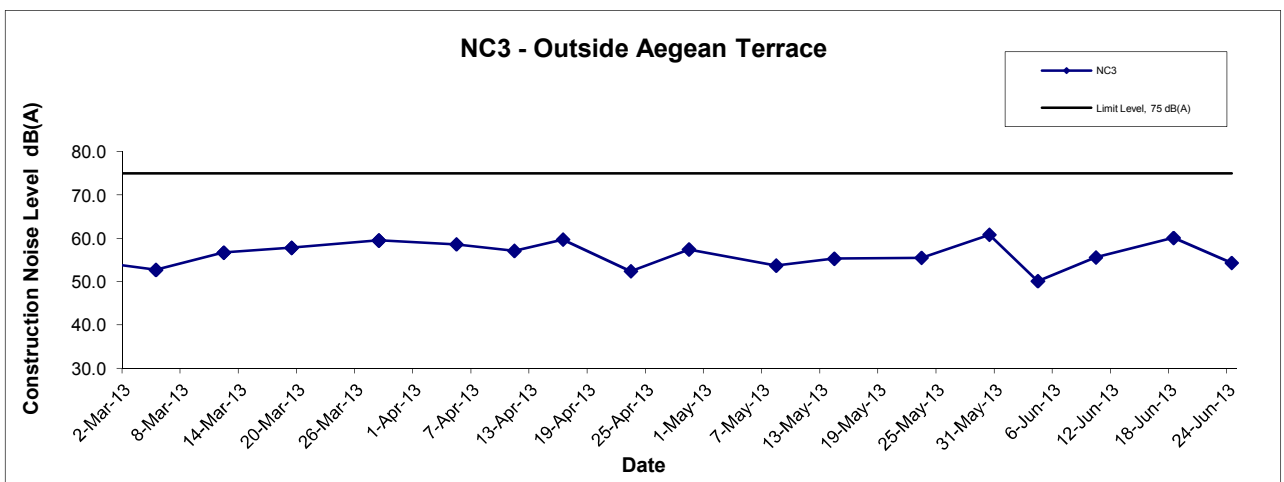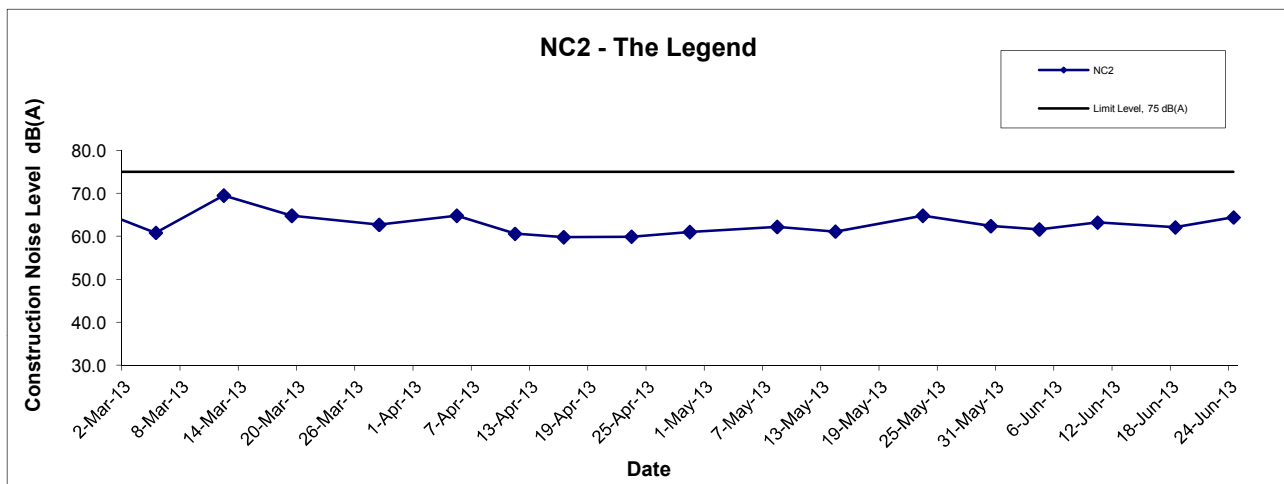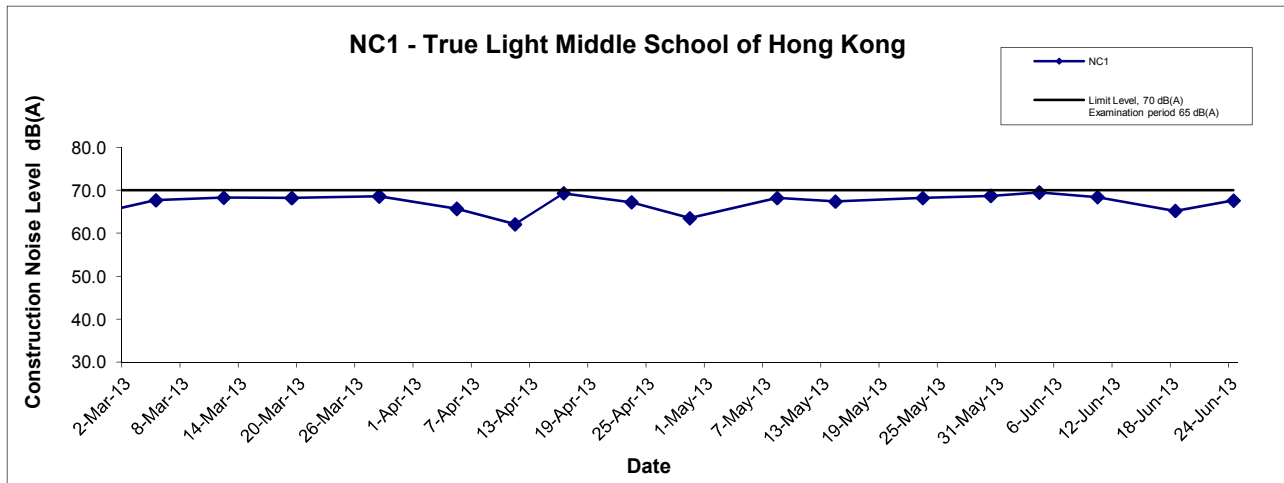




| | | | | |
|---|---|--------|-------------|----------|
| Title | Contract No. DC/2007/10 | Scale | Project No. | CINOTECH |
| | Design and Construction of Hong Kong West Drainage Tunnel | N.T.S | MA8001 | |
| Graphical Presentation of Construction Noise Monitoring Results | | Date | Appendix | |
| | | Jun 13 | E | |

Noise Levels

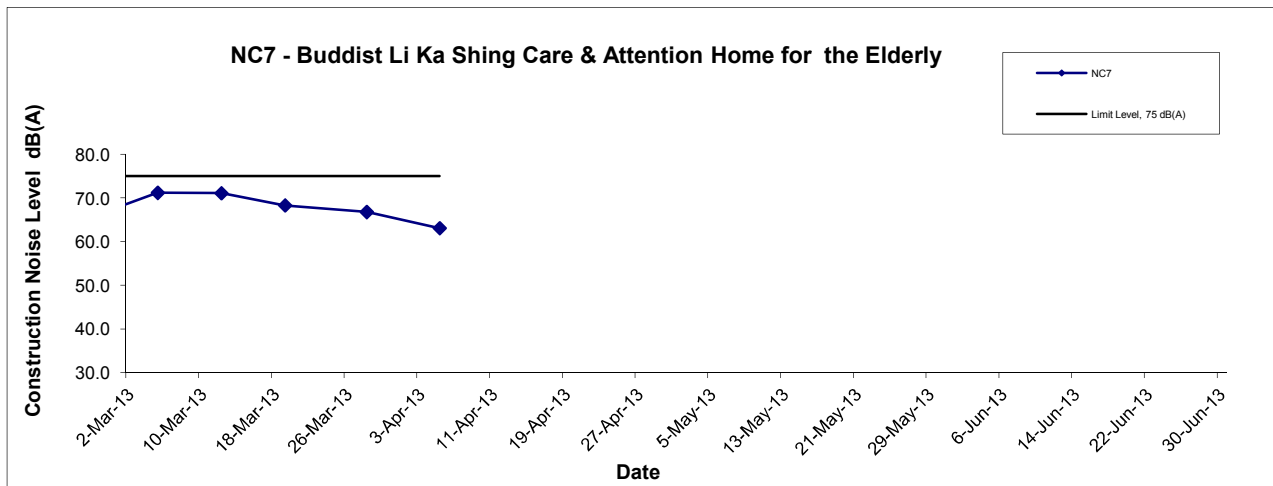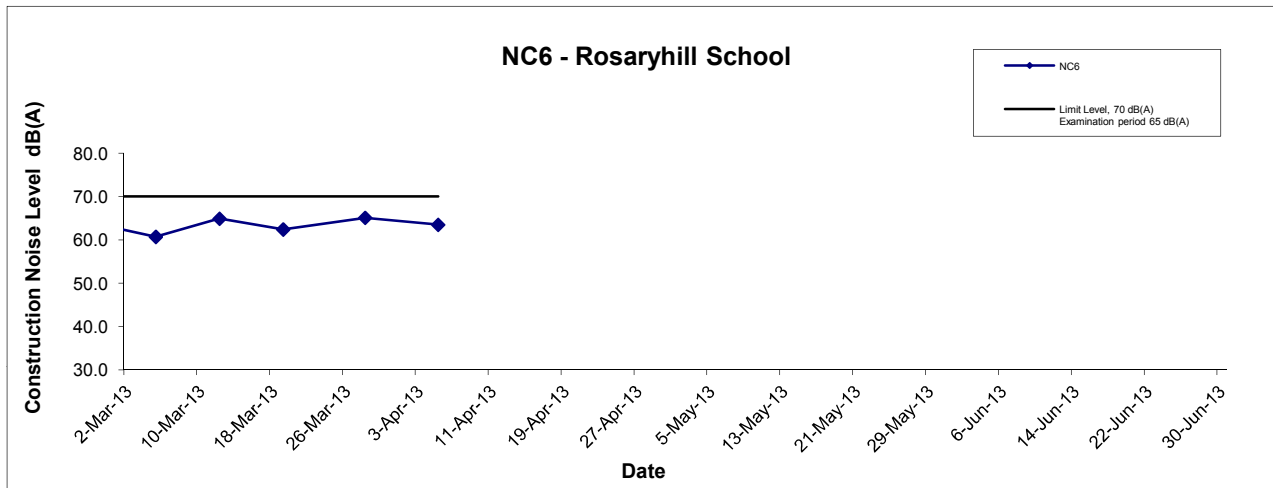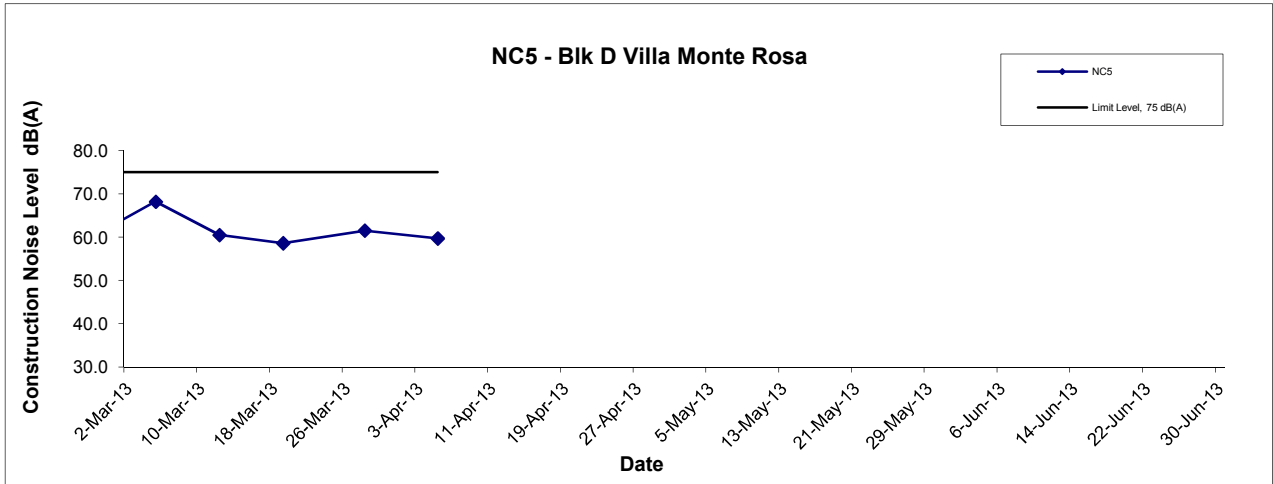




| | | | |
|---|-----------------------|------------------------------|--|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results | Scale N.T.S | Project No. MA8001 | |
| | Date Jun 13 | Appendix E | |

Noise Levels

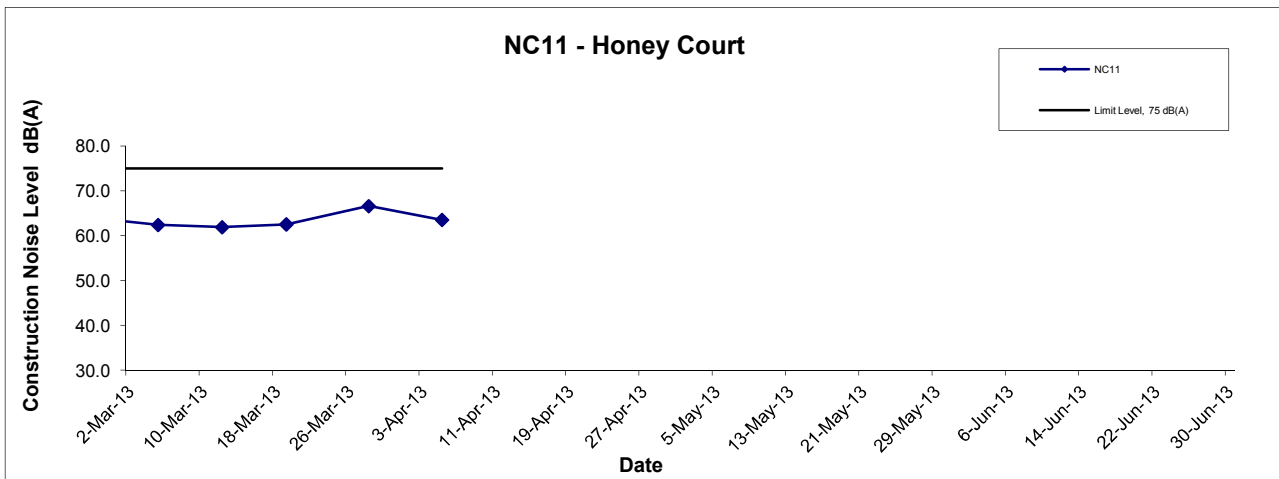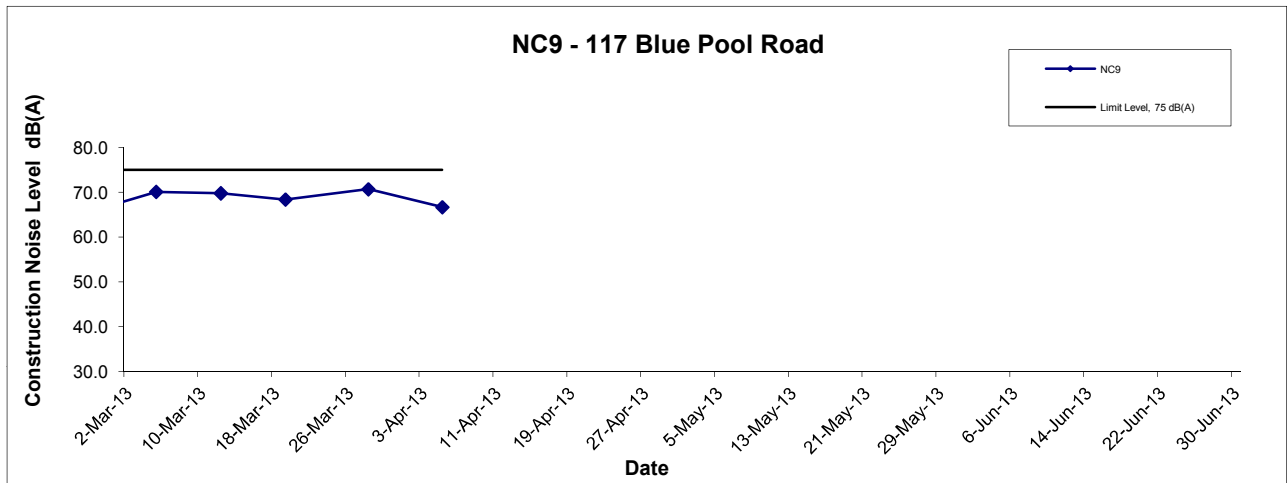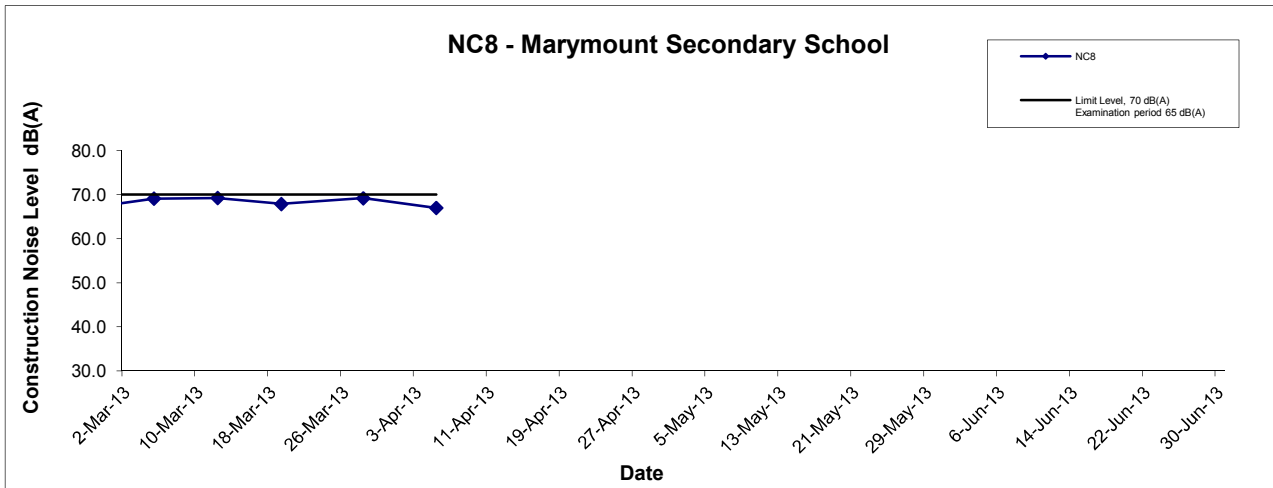




| | | | |
|---|-----------------------|------------------------------|--|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results | Scale N.T.S | Project No. MA8001 | |
| | Date Jun 13 | Appendix E | |

Noise Levels

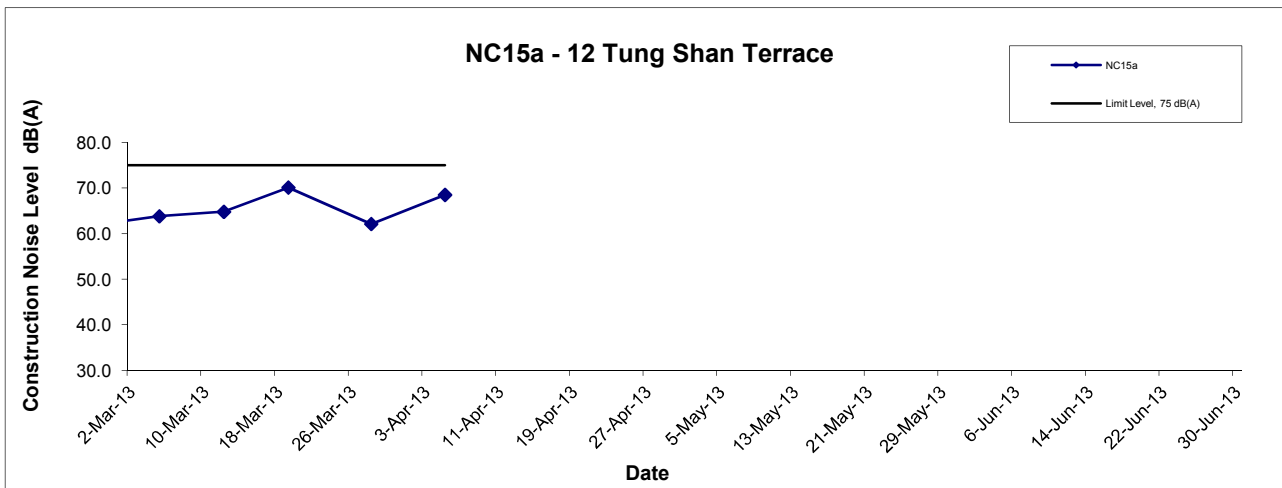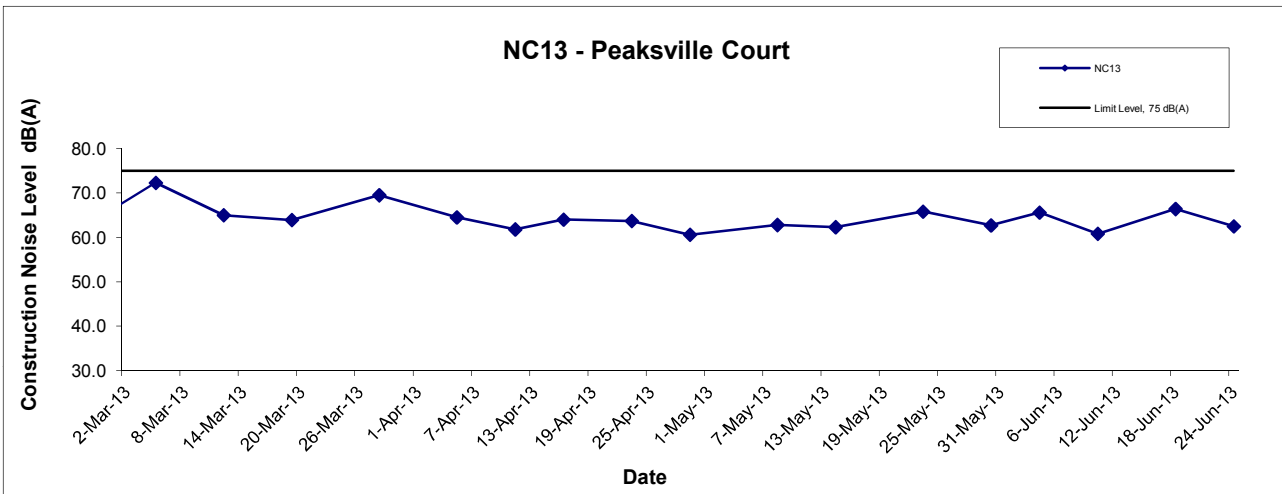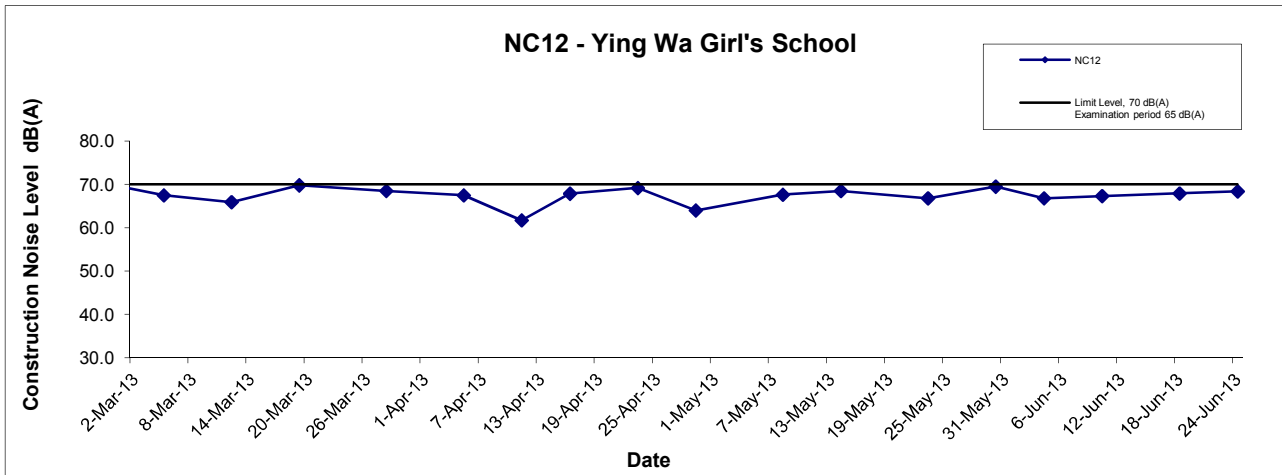


| | | | |
|---|-----------------------|------------------------------|--|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results | Scale N.T.S | Project No. MA8001 | |
| | Date Jun 13 | Appendix E | |

Noise Levels

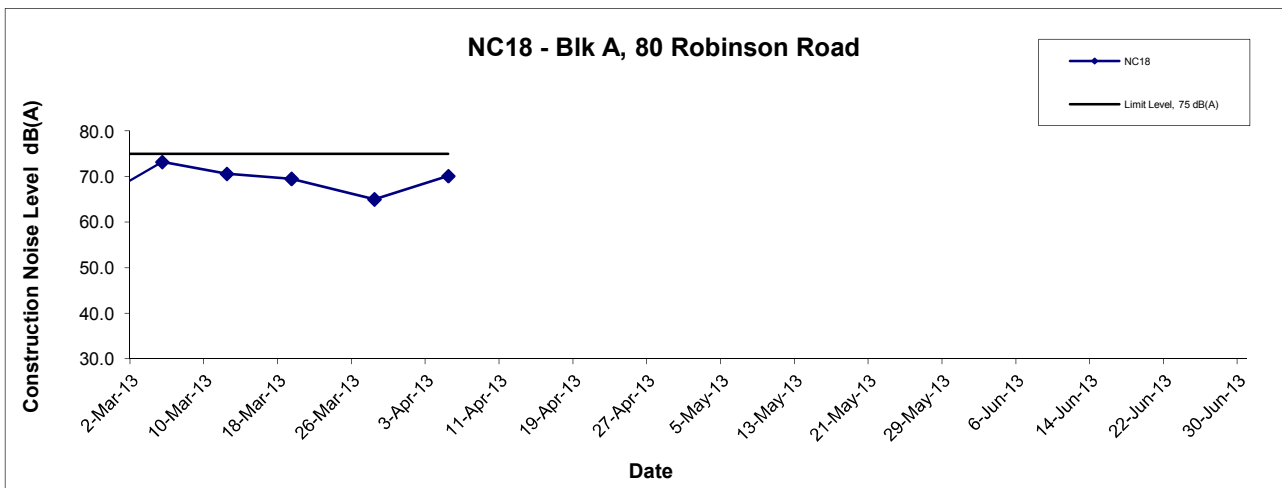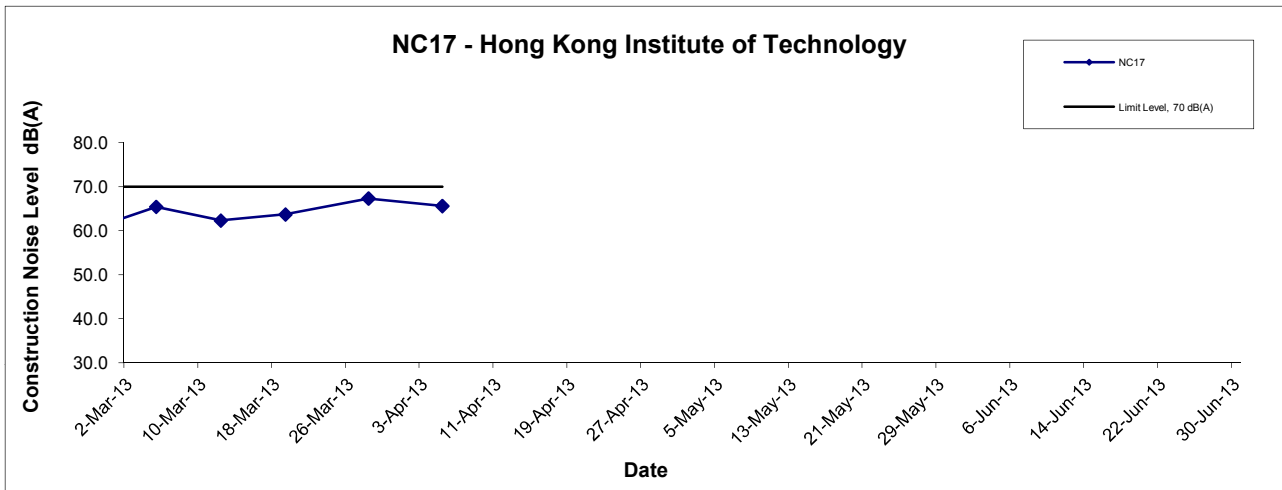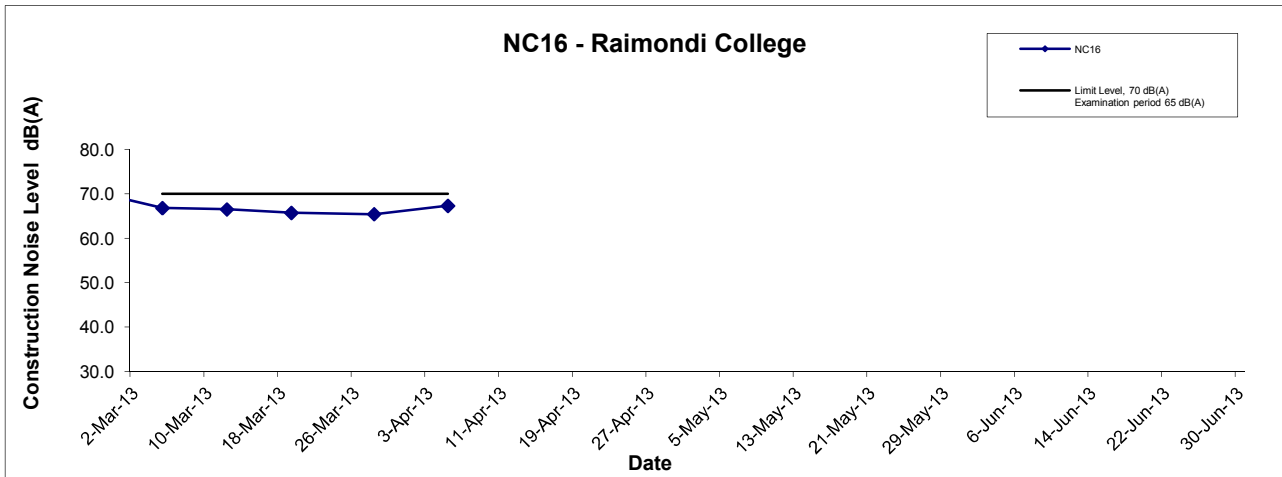

| | | | |
|---|-----------------------|------------------------------|--|
| Title Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results | Scale N.T.S | Project No. MA8001 | |
| | Date Jun 13 | Appendix E | |

Noise Levels

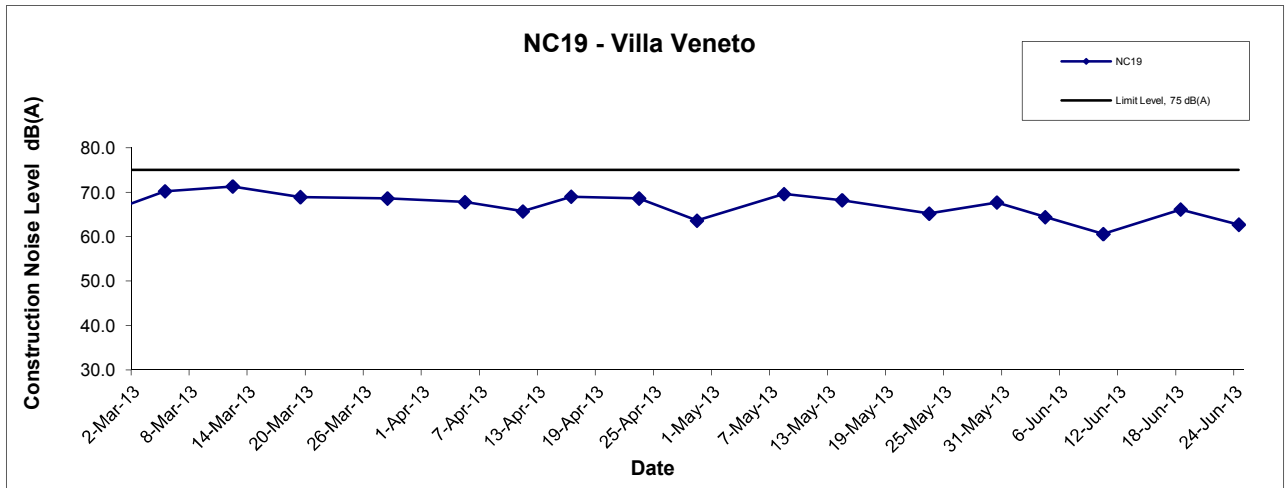

| | | | | |
|-------|---|----------------------|----------------------|----------|
| Title | Contract No. DC/2007/10 Design and Construction of Hong Kong West Drainage Tunnel Graphical Presentation of Construction Noise Monitoring Results | Scale | Project No. | CINOTECH |
| | | N.T.S Date Jun 13 | MA8001 Appendix E | |

APPENDIX F
ENVIRONMENTAL MITIGATION
IMPLEMENTATION SCHEDULE (EMIS)

Appendix F - Summary of Environmental Mitigation Implementation Schedule

| Types of Impacts | Mitigation Measures | Status |
|-------------------|---|--------|
| Construction Dust | <i>Dust Mitigation Measures</i> | |
| | <ul style="list-style-type: none"> The Contractor shall undertake at all times to prevent dust nuisance as a result of his activities. Effective dust suppression measures should be installed to minimize air quality impacts, at the boundary of the site and at any sensitive receivers. | ^ |
| | <ul style="list-style-type: none"> No blasting shall be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted (unless prior permission of the Commissioner of Mines is obtained). | ^ |
| | <ul style="list-style-type: none"> Effective water sprays shall be used during the delivery and handling of all raw sand, aggregate and other similar materials, when dust is likely to be created, to dampen all stored materials during dry and windy weather. Watering of exposed surfaces shall be conducted as often as possible depending on the circumstances. | ^ |
| | <ul style="list-style-type: none"> A watering programme of once every 2 hours in normal weather conditions, and hourly in dry/windy conditions. | ^ |
| | <ul style="list-style-type: none"> Any stockpile of dusty material cannot be immediately transported out of the Site shall be either: a) covered entirely by impervious sheeting; b) placed in an area sheltered on the top and the three sides; or c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet. | * |
| | <ul style="list-style-type: none"> Should a conveyor system be used, the Contractor shall implement the following precautionary measures. Conveyor belts shall be fitted within windboards. Conveyor transfer points and hopper discharge areas shall be enclosed to minimize dust emission. All conveyors under control of the Contractor, and carrying materials which have the potential to create dust, shall be totally enclosed and fitted with belt cleaners. | ^ |
| | <ul style="list-style-type: none"> Any dusty materials being discharged to vehicle from a conveying system at fixed transfer point, three-sided roofed enclosed with a flexible curtain across the entry shall be provided. Exhaust fans shall be provided for this enclosure and vented via a suitable fabric filter system. | ^ |
| | <ul style="list-style-type: none"> The heights from excavated spoils are dropped should be minimise to reduce the fugitive dust arising from unloading/loading. | ^ |
| | <ul style="list-style-type: none"> The Contractor shall confine haulage and delivery vehicles to designated roadways inside the site. If in the opinion of the Engineer, any motorising vehicle is causing dust nuisance, the Engineer may require that the vehicle be restricted to a maximum speed of 15km per hour while within the site area. | ^ |
| | <ul style="list-style-type: none"> Areas within the site where there is a regular movement of vehicles shall have an approved hard surface, be kept clear of loose surface materials and / or be regularly watered. | ^ |
| | <ul style="list-style-type: none"> Wheel cleaning facilities shall be installed for both portals and used by all vehicles leaving the site. No earth, mud, debris, dust and the like shall be deposited on public roads. Water in the wheel cleaning facility shall be changed at frequent intervals and sediments shall be removed regularly. The Contractor shall submit details of proposals for the wheel cleaning facilities to the Engineer prior to construction of the facility. Such wheel cleaning facilities shall be usable prior to any earthwork excavation activity on site. The Contractor shall provide a hard-surfaced road between any cleaning facility and the public road. | ^ |
| | <ul style="list-style-type: none"> Chemical wetting agents shall only be used on completed cuts and fills to reduce wind erosion. | N/A |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|--|
| | <ul style="list-style-type: none"> No vehicle exhausts shall be directed towards the ground or downwards to minimize dust nuisance. Ventilation system, equipped with proprietary filters, should be provided to ensure the safe working environment inside the tunnel. Particular attention should be paid to the location and direction of the ventilation exhausts. The exhausts should not be allowed to face any sensitive receivers directly. Consideration should also be given to the location of windows, doors and direction of prevailing winds in relation to the nearby sensitive receivers. In the event of any spoil or debris from construction works being deposited on adjacent land, or stream, or any silt being washed down to any area, then all such spoil, debris or material and silt shall be immediately removed and the affected land and areas restored to their natural state by the Contractor to the satisfaction of the Engineers. <p>In addition, based on the <i>Air Pollution Control (Construction Dust) Regulation</i>, any works involved regulatory and notifiable works, such as stockpiling, loading and unloading of dusty materials, shall take precautions to suppress dust nuisance.</p> <ul style="list-style-type: none"> The working area of any excavation or earthmoving operation shall spray with water or a dust suppression chemical immediately before, during and immediately after the operation so as to maintain the entire surface wet; Exposed earth shall be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies; and Any stockpile of dusty materials (greater than 20m³) shall be either covered entirely by impervious sheeting or placed in an area sheltered on the top and three sides; and sprayed with water or a dust suppression chemical so as to maintain the entire surface wet. Other suitable dust control measures as stipulated in <i>Air Pollution Control (Construction Dust) Regulation</i>, where appropriate, should be adopted. | <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|--------------------|---|--------|
| Construction Noise | <u>Air borne noise</u> | |
| | In general, potential construction noise impact can be minimized or avoided by imposing a combination of the following mitigation measures: | |
| | <ul style="list-style-type: none"> Noisy equipment and activities should be sited by the Contractor as far from close-proximity sensitive receivers as practical. Prolonged operation of noisy equipment close to dwellings should be avoided. | ^ |
| | <ul style="list-style-type: none"> The Contractor should minimise construction noise exposure to the schools (especially during examination periods). The Contractor should liaise with the school and the Examination Authority to ascertain the exact dates and times of all examination periods during the course of the works contract and to avoid noisy activities during these periods. | ^ |
| | <ul style="list-style-type: none"> Noisy plant or processes should be replaced by quieter alternatives. Silenced diesel and gasoline generators and power units, as well as silenced and super-silenced air compressor, can be readily obtained. | ^ |
| | <ul style="list-style-type: none"> Noisy activities should be scheduled to minimise exposure of nearby sensitive receivers to high levels of construction noise. For example, noisy activities can be scheduled for midday, or at times coinciding with periods of high background noise (such as during peak traffic hours). | ^ |
| | <ul style="list-style-type: none"> Idle equipment should be turned off or throttled down. Noisy equipment should be properly maintained and used no more often than is necessary. | ^ |
| | <ul style="list-style-type: none"> The power units of non-electric stationary plant and earth-moving plant should be quietened by vibration isolation and partial or full acoustic enclosures for individual noise-generating components. | ^ |
| | <ul style="list-style-type: none"> Construction activities should be planned so that parallel operation of several sets of equipment close to a given receiver is avoided, thus reducing the cumulative impacts between operations. The numbers of operating items of powered mechanical equipment should be minimised. Noise can be reduced by increasing the distance between the operating equipment and the NSRs or by reducing the number of items of equipment and/or construction activity in the area at any one time. | ^ |
| | <ul style="list-style-type: none"> The use of quiet plant working methods can further reduce noise level. Quiet plant is defined as Powered Mechanical Equipment (PME) whose actual sound power level is less than the value specified in the TMs for the same piece of equipment. To allow the Contractor some flexibility to select equipment to suit his needs, it is considered too restrictive to specify which specific items of silenced equipment to be used for the construction operations. It should be noted that various types of silenced equipment can be found in Hong Kong and are readily available on the market. BS 5228 also provides examples of quiet construction plant and their SWL. | ^ |
| | <ul style="list-style-type: none"> Construction plant should be properly maintained (well-greased, damage and worn parts promptly replaced) and operated. Construction equipment often has silencing measures built in or added on, e.g. bulldozer silencers, compressor panels, and mufflers. Silencing measures should be properly maintained and utilised. Rubber or damping materials should be introduced between metal panels to avoid rattle and reverberation of noise. | ^ |
| | <ul style="list-style-type: none"> Equipment known to emit sound strongly in one direction should be oriented so that the noise is directed away from nearby NSRs. | ^ |
| | <ul style="list-style-type: none"> Materials stockpile and other structures (such as site offices) should be effectively utilised to shield construction noise. Noise | ^ |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|---|
| | <p>can also be reduced by construction of temporary noise barriers which screen the lower floors from viewing the sites. Temporary noise barriers should be installed at active parts of construction areas where construction equipment is being operated in close proximity to NSRs.</p> <ul style="list-style-type: none"> It is noted that under the WBTC No. 19/2001, all construction sites are required to use metallic site hoarding can be slightly modified (with the addition of steel backings) into temporary noise barriers. These barriers should be gap free and have a surface mass density of at least 7kg/m². All hand-held percussive breakers and air compressors should comply the Noise Control (Hand-held Percussive Breakers) Regulations respectively under the NCO (Ordinance No. 75/88, NCO Amendment 1992 No.6). <p>The Contractor shall devise, arrange methods of working and carry out the works in such manner as to minimise noise impacts on the surrounding environment, and shall provide experienced personnel with suitable training to ensure that these measures are implemented properly.</p> <p><u>Level 2 Use of Barriers</u></p> <p>Level 2 mitigation measures include providing movable barriers for sites which have sufficient space for installation, full enclosures during the drilling activities at Eastern Portal and at muck pit areas for Eastern portals and cantilever-typed high rise noise barrier for intake W5 (P) and W8.</p> <p>Before construction of the full enclosure at muck pit area, the use of full enclosure noise barrier (Stage A) for the drilling activities at the Eastern Portal area is required. A full enclosure for the muck pit area will then be constructed at this later stage (Stage B). The full enclosure shall be gap free apart from necessary entrance/exits, which shall face towards the entrance of eastern portal to minimize the amount of noise generated from affecting the nearest RNSRs especially school (True Light Middle School of Hong Kong).</p> <p>5m high cantilever-typed hoarding barrier to be built at W5 (P) and W8. These enclosures/barriers should have no gaps and have a superficial surface density of at least 10kg/m². Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period. To schedule the noise barrier erection and dismantling to the non sensitive periods of school to avoid adverse impact to W8/3.</p> <p>Movable barriers of 3 to 5m height with a small cantilevered upper portion and skid footing to be located within about 5 m or more for mobile equipment such that the line of sight is blocked. To provide purposes-built noise barriers or screens constructed of appropriate materials (minimum superficial density of 10kg/m²) located close to the operating PME.</p> <p>Pre-drilling following by chemical splitting instead of using large excavator mounted breaker should be used as mitigation measure for rock breaking and rock drilling.</p> | <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> <p>^</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|--|-------------------|
| | <p>No construction activity is recommended during the examination period.</p> <p><u>Ground borne noise</u></p> <p>The noise level should be measured on the ground floor inside the nearest building during the TBM construction work in the daytime. If the daytime monitored ground borne noise exceeds the relevant evening/night ground borne noise criteria, evening/night construction work would not be carried out for the concerned tunnel section. Evening/night time construction work is subject to CNP application under the control of NCO.</p> <p>Public relationship strategy with 24-hour hotline system.</p> | <p>^</p> <p>^</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|--------|
| Water Quality | <u>Precautionary measures for construction work near natural streams</u> | |
| | The government provides guidelines (ETWB TCW NO. 5/2005 and DSD TC 2/2004) are providing guidelines to minimize impacts when there is construction work carried out at near natural streams course. Relevant mitigation measures for the intakes are summarised as follows: | |
| | <ul style="list-style-type: none"> • Temporary site access to the work sites should be carefully planned and located to minimize disturbance caused to the substrates of streams/rivers and riparian vegetation by construction plant. | ^ |
| | <ul style="list-style-type: none"> • Locations well away from the rivers/streams for temporary storage of materials (e.g equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil should be identified before commencement of works. | ^ |
| | <ul style="list-style-type: none"> • Proposed works site areas inside, or in the proximity of, natural rivers and streams should be temporarily isolated to prevent adverse impacts on the stream water qualities. | ^ |
| | <ul style="list-style-type: none"> • Stockpiling of construction materials, if necessary, should be completely properly covered and located away from any natural stream/river. | ^ |
| | <ul style="list-style-type: none"> • Construction debris and spoil should be covered up and/or properly disposed of as soon as possible to avoid being washed into nearby rivers/streams by rain and local runoff. | * |
| | <u>Construction of temporary berthing point at the Western Portal</u> | |
| | A refuse collection vessel shall be provided to collect refuse or materials lost into the sea. | ^ |
| | The respective areas of the marine works will be completely enclosed by the silt curtain. The curtain shall be extended from water surface down to the seabed where it is anchored using sinker blocks. The Contractor shall inspect the silt curtain on regular basis to ensure its integrity and it is serviceable for all times. | N/A |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|--------|
| | Transfer of armour rock onto the seabed from barge at the temporary pier location should be conducted by careful grabbing and unloading to the seabed (to minimize sediment migration). | ^ |
| | The conveyor belt should be completely covered and muddy effluent from the temporary barge should be contained, treated and disposed. Where there is transfer of excavated wastes, the Contractor should provide appropriate measures to ensure that the waste is free from floatables, putrescibles, organic wastes and toxic materials and when required a refuse collection vessel be provided to collect float refuse. | ^ |
| | <u>Construction of stilling basin at Western Portal outfall</u> | |
| | All construction for the basin should be carried out inside the temporary cofferdam which is a temporary watertight enclosure built in the water and pumped dry to expose the bottom so that construction of stilling basin can be undertaken. | ^ |
| | During the dewatering process, appropriate desilting/sedimentation devices should be provided on site for treatment before discharge. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge. | ^ |
| | The cofferdam will remain on site until after the construction of stilling basin has been completed. The coffer dam shall be regularly inspected and maintained to ensure no spillage of waste or wastewater into the sea. Conveyance of dredged materials from the coffer dam shall be carried out cautiously to avoid spillage into the sea. | ^ |
| | The filled material for the stilling basin should be contained inside the temporary cofferdam. The top level of the cofferdam shall be constructed higher than the final backfilled level. | ^ |
| | The Contractor shall be responsible for the design, installation and maintenance of the silt curtains to minimize the impacts on the water quality and the protection of water quality. The design and specification of the silt curtains shall be submitted by the Contractor to the Engineer for approval. | N/A |
| | Silt curtains shall be formed from tough, abrasion resistant, permeable membranes, suitable for the purpose, supported on floating booms in such a way as to ensure that the sediment plume shall be restricted to within the limit of the works area. The silt curtain shall be formed and installed in such a way that tidal rise and fall are accommodated, with the silt curtains always extending from the surface to the bottom of the water column and held with anchor blocks. The removal and reinstallation of such curtains during typhoon conditions shall be as agreed with the Director of Marine Department. The contractor shall regularly inspect the silt curtains and check that they are moored and marked to avoid danger to marine traffic. Any damage to the silt curtain shall be repaired by the Contractor promptly and the works shall be stopped until the repair is fixed to the satisfaction of the Engineer. | N/A |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|--|---|
| | <p>Transfer of rock fill material (armour rock) from the barge onto the site location should be conducted by grabbing and placement on the seabed to minimize sediment migration. No free dropping of the material will be allowed.</p> <p>Prior to the construction of armor rock based panel, a silt curtain shall also be installed prior to carry out any marine works as a preventive mitigation measure.</p> <p><u>Construction of TBM tunnel at both portals and intakes</u></p> <p>Recycled water will be used at the cutter face for cooling purposes. Used water will be collected and discharged to a settling tank for settlement. Excess water from the settling tank will be transferred to the water treatment plant on site where the addition of flocculants will assist in settlement of solids. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge.</p> <p>During the drilling process, all flushing water will be recycled for use. Discharge of the treated water to nearby drainage system shall be allowed provided that it has been treated to a level meeting with statutory requirements.</p> <p>Water flow at streams should be maintained by a temporary diversion system during the construction phase of intakes and manhole drop shafts.</p> <p><u>General Construction Activities and Workforce</u></p> <p>A. Surface runoff</p> <p>Effluent produced from construction activities are subjected to WPCO control. Effluent produced from sites should be diverted away from stream courses. Construction works near stream course should be scheduled in the dry season as far as practical to avoid excessive site runoff discharge.</p> <p>Under the <i>Water Pollution Control Ordinance</i> (WPCO), turbid water from construction sites must be treated to minimize the solids content before being discharged into storm drains. The suspended solids load can be reduced by directing the runoff into temporary sand traps or other silt-removal facilities, and other good and appropriate site management practices. Advice on the handling and disposal of construction site discharge is provided in the ProPECC Paper (PN 1/94) on Construction Site Drainage.</p> <p>A drainage system layout should be prepared by the Contractor for each of the works areas (portals and intakes), detailing the facilities and measures to manage pollution arising from surface runoff from those works areas. The drainage layout and an associated drainage management plan to reduce surface runoff sediments and pollutants entering watercourses, should be submitted to the Engineer for approval and to EPD for agreement.</p> | <p>^</p> <p>N/A</p> <p>^</p> <p>^</p> <p>^</p> <p>*</p> <p>*</p> <p>*</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|--|--|
| | <p>The system should be capable of handling stormwater from the site and directing it to sediment removal facilities before discharge. If oil and grease is used on the site or brought to the site, the stormwater should pass through oil interceptors before discharge. The interceptors should have a bypass to prevent washout in heavy storms.</p> <p>A temporary channel system or earth bunds or sand barriers should be provided in works areas on site to direct stormwater to silt-removal facilities. Stockpiled materials, if susceptible to erosion of rain or wind, should be covered with tarpaulins (or/similar fabric) or hydroseedings as far as practicable especially during the wet season.</p> <p>Silt removal facilities should be checked and the deposited silt and grit should be removed regularly to ensure these facilities are in good working condition and to prevent blockages.</p> <p>Vehicle washing areas should be drained into a settlement basin to settle out the suspended solid before discharge to storm water drains. The water should be recycled on site whenever possible. It is suggested that the wash water from the wheel wash basin is either reused for road watering or pumped to the on-site settling tanks for treatment. Water used for dust depression purposes should be minimized and an alternative soil holding agent should be considered.</p> <p>B. Spillage, Oil and Solvents</p> <p>Any contractor generating waste oil or other chemicals as a result of his activities should register as a chemical waste producer and provide a safe storage area for chemicals on site. Oil interceptors need to be regularly inspected and cleaned to avoid wash-out of oil during storm conditions. A bypass should be provided to avoid overload of the interceptor's capacity.</p> <p>Any spillage should be cleaned up immediately and the resulting contaminated absorbent material should be properly managed according to Waste Disposal Regulations. Spills should be contained to avoid spreading and contaminating the water resources.</p> <p>Oil and fuels should be used and stored properly in designated area. All fuel tanks and storage areas should be provided with locks and be sited on within sealed areas within surrounded by bunds of with a capacity equal to 110% of the storage capacity of the largest tank.</p> <p>Good housekeeping practices are required to minimize careless spillage and keep the work space in a tidy and clean condition. Appropriate training, including safety codes and relevant manuals, should be given to the personnel who regularly handle the chemicals on site.</p> | <p>^</p> <p>*</p> <p>*</p> <p>^</p> <p>^</p> <p>*</p> <p>*</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|--|
| | <p>C. On-Site Effluent Generation</p> <p>Sewage arising from the additional population of workers on site should be collected in a suitable storage facility (chemical mobile toilets). Most of the work site locations are close to the public sewerage system, and therefore the use of septic tanks isare, therefore, not encouraged. Portable toilets should be used coupled with tickering away services provided by a licensed collector. They should be positioned at appropriate locations across the site to ensure no direct discharge of foul water off-site.</p> <p>D. Protection of Existing Flora and Fauna</p> <p>The Contractor should provide details of the plant and operation plans at each site for approval by the Engineer before commencing construction. The plans should include how the existing flora and fauna will be protected. Locations required for groundwater levels monitoring are Eastern Portal, PFLR1(P), THR2(P), TP5, TP789 and W12.</p> <p>The construction and demolition of the temporary pier may create short term impacts on the local marine water quality. The situation will be restored once the work is finished by proper phasing of the works programme and implementation of the adequate mitigation measures (e.g. silt curtain) the impacts will be minimized.</p> <p><u>Maintaining Baseflow in Downstream Watercourses</u></p> <p>The final design will be developed during the detailed design stage. The exact base flow rates to be maintained at each of the intakes will be subject to detailed site investigation at design stage.</p> <ul style="list-style-type: none"> • Purpose of the by-pass device is to maintain the base-flow of the affected stream course. • The by-pass system comprises an approach link and a trapezoidal channel. • The approach link is section with inclined profiled surface at a gradient of 1 in 100. It is used to direct the base flow to the bypass trapezoidal channel at its down stream end during the normal days. • The trapezoidal channel is sized such that it could handle the base flow in the affected stream course which is estimated to be no more than 20 l/s. • Whenever the flow in the stream course exceeding the base flow rate, the excessive flow will overflow into the intake structure via the bottom rack structure. The bottom rack structure has bar screen on the top and inclined channel at the bottom. The top level of the bar screen is level with the by-pass channel with an aim to receive the overflow from the by-pass channel. • The by-pass channel is designed requiring minimum maintenance. However, it is recommended that the maintenance authority carry out regular maintenance inspection prior to onset of seasons and after significant rainstorm event to prevent blockage of the by-pass and bottom rack structure. | <p>^</p> <p>^</p> <p>^</p> <p>N/A N/A N/A</p> <p>N/A</p> <p>N/A</p> <p>N/A</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|--------|
| Waste/Chemical | <u>General</u> A proper waste management plan should be implemented to promote waste minimisation at source. Where waste generation is unavoidable then the potential for recycling or reuse should be explored and opportunities taken. If wastes cannot be recycled then the recommended disposal routes should be followed. All waste materials shall be segregated into categories covering: <ul style="list-style-type: none"> Excavated material or construction waste suitable for reuse on-site Excavated material or construction waste suitable for public filling areas Remaining C&D waste for landfill Chemical waste, and General refuse | * |
| | Proper segregation and disposal of construction waste should be implemented. Separate containers for inert and non-inert wastes should be provided. The inert waste should be taken to public filling area and the non-inert waste should be transported to strategic landfills. | ^ |
| | A trip-ticket system on the solid waste transfer/disposal operations should be included as one of the contractual requirements (ETWB TCW No. 31/2004). The Independent Environmental Checker (IEC) should be responsible for auditing this system. | ^ |
| | IEC should also be responsible for auditing the well-documented record system which includes: (i) quantity of waste generation, (ii) quantity of recycled material, (iii) quantity of disposed material, (iv) disposal methods and (v) sites should be implemented during construction phase. | ^ |
| | Regular cleaning and maintenance of the waste storage area should be conducted throughout the construction stage. | ^ |
| | <u>Excavated spoil</u> Control measures for soil temporarily stockpiled on-site should be taken in order to minimize the noise, generation of dust, pollution of water and visual impact. Key impacts include: | ^ |
| | | |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|---------------------|---|-------------------------------------|
| Terrestrial Ecology | <p>During the detailed design stage, the following issues should also be considered as possible to further minimise the impacts:</p> <ul style="list-style-type: none"> Adjustment of site boundary to minimise temporary loss of natural stream habitat during construction. Adjustment of site boundary to minimise use of mixed woodland as temporary works area. In particular, the woodland habitat in temporary works area of the Eastern Portal will be avoided, thereby greatly reducing the area of temporary loss of woodland habitat. Minimizing felling of large trees. About 20% of trees within the works area will be transplanted. The individual of <i>Artocarpus hypargyreus</i> recorded within the temporary works area of HKU1, if to be encroached, would also be transplanted. | <p>^</p> <p>^</p> <p>^</p> <p>^</p> |
| | <p>Standard site practices including the following, should be enforced to minimise the disturbance to the surroundings:</p> <ul style="list-style-type: none"> Treat any damage that may occur to large individual trees in the adjacent area using materials and methods appropriate for tree surgery. Reinstate work sites/disturbed areas immediately after completion of the construction works, in particular, through on-site tree/shrub planting along the woodland and shrubland section within the temporary works area. Tree/shrub species used should make reference from those in the surrounding area. Regularly check the work site boundaries to ensure that they are not exceeded and that no damage occurs to surrounding areas. | <p>^</p> <p>^</p> <p>^</p> |
| | <p>A total of 1.02 ha would be replanted with woodland species, reaching almost a 1.5:1 ratio for compensatory planting. Tree/shrub species used should be based on those in the surrounding areas, including those which are commonly recorded during the baseline surveys.</p> | <p>^</p> |
| | <p>A low-flow channel would be provided within the channelised section to maintain a deeper water depth in the expanded channel, in particular during dry season as well as a basin at the end of the channelised section to provide living space for aquatic life. Step chute in the form of a series of descending water pools would be constructed between the low flow channel and the undisturbed stream course. There would also be openings for aquatic fauna between each chute step (pool). These could work like a “ladder” to help avoid isolating the aquatic fauna in the channelised section from natural habitats.</p> | <p>^</p> |
| | <p>Measures are also needed to maintain the flow of all affected streams/nullahs during the construction stages. Temporary bypass should be provided if the stream/nullah flows will be cut off by the construction works. After the construction works are finished, sections of temporary loss should be reinstated. Construction materials, wastes, and equipment should be cleared from the sites.</p> | <p>^</p> |
| | | |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|------------------|---|------------------------------|
| | <p>Surveys of amphibians at E4(P), PFLR1(P), W12(P), MB16, E5(B)(P), TP789(P) and P5(P) prior to commencement of construction is recommended. Frogs, including Hong Kong Cascade Frog and Lesser Spiny Frog, and tadpoles found at work areas of these proposed intake points will be collected and translocated to nearby streams that will not be affected by the project. These procedures should be performed by experienced herpetologists. A detailed translocation proposal will be submitted during the detailed design stage.</p> <p>Measures should also be taken to avoid runoff to streams and marine habitats. Stream/channel which could potentially be affected during construction should be prevented from sedimentation by erection of sediment barriers. Site runoff should be desilted by siltation traps in streams/channels or diverted, to reduce the potential for suspended sediments, organics and other contaminants to enter the local stream environment.</p> | <p>^</p> <p>^</p> |
| Marine Ecology | <p>Silt curtains will be deployed during the construction and demolition of the temporary berthing point. Deployment of silt curtains around the berthing point area would effectively avoid adverse water quality impacts due to barge filling. No significant ecological impact is anticipated.</p> <p>The invert of the stilling basin would be at -5.4 mPD. A cofferdam in the form of pipe-pile wall is to be constructed outside the stilling basin prior to the construction of basin. The cofferdam will be dewatered to provide a working area for construction of the stilling basin. The boulders from the seawall will then be removed by landbased grabs.</p> <p>Although the speed of the working vessels to be used in the Project (mainly barges) would not be high, a speed limit for marine traffic is proposed as a precautionary measure. A speed limit of 10 knots should be strictly enforced in the works area, in particular in the waters between the outfall location and the navigation channel in East Lamma Channel.</p> | <p>N/A</p> <p>^</p> <p>^</p> |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|----------------------|--|--------|
| Landscape and Visual | The proposed landscape and visual mitigation measures during the construction phase include: | |
| | CM1 - Topsoil, where identified, should be stripped and stored for re-use in the construction of the soft landscape works, where practical. | ^ |
| | CM2 - Existing trees to be retained on site should be carefully protected during construction. The detailed proposal for any trees felling and transplantation is subject to Lands Department's approval on tree felling application at the detailed design stage. | ^ |
| | CM3 - Trees unavoidably affected by the works should be transplanted where practical. | ^ |
| | CM4 - Compensatory tree planting should be provided to compensate for felled trees. | ^ |
| | CM5 - The extent of disturbance on the existing stream course should be minimized. Any temporary works areas within the stream course shall be reinstated after construction. | ^ |
| | CM7 – Control of night-time lighting | ^ |
| | CM8 – Erection of decorative screen hoarding | ^ |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|-------------------|--|--------|
| Cultural Heritage | <p>The Cultural Heritage Impact Assessment has identified the following resources which will require mitigation measures during the construction stage;</p> <p><u>Haw Par Mansion (including boundary wall and gate)</u></p> <p>A condition survey must be undertaken by a qualified professional prior to the commencement of construction works for the tunnel portal in order to assess the structural integrity of the mansion, wall and gate (with special attention paid to any fragile architectural features). A report containing description of the types of construction, identification of fragile elements, an appraisal of the condition and a photographic record must be prepared. The report must also provide an assessment indicating whether further precautionary measures will be necessary during the construction phase, and if so provide details for sufficient protective measures, including monitoring for vibration control to ensure that no damage to the structure and fabric of the house, wall and gate results from the construction works. The report must be submitted to AMO for approval before construction activities commence. Upon approval the appropriate monitoring and precautionary measures shall be put into place.</p> | ^ |
| | <p>A buffer zone with a minimum width of 3 metres and an obstruction free access point must be maintained between the boundary wall/gate and the temporary works area (during construction works associated for both the tunnel portal and the permanent vehicle access ramp). This is to enable access for routine maintenance works on the wall and to ensure that the wall is not damaged by machinery operation or related construction activities. The temporary works area will be enclosed by standard DSD site hoarding.</p> | ^ |
| | <p><u>Former Explosive Magazine of Victoria Barracks</u></p> <p>A condition survey must be undertaken by a qualified professional prior to the commencement of construction works in order to assess the structural integrity of the retaining wall and the extent of damage from cracks and vegetation growth. A report containing a description of the wall's construction materials, identification of fragile and/or endangered elements, an appraisal of the condition and a photographic record of the retaining wall must be prepared. The report must also provide an assessment indicating whether further precautionary measures will be necessary during the construction phase, and if so provide details for sufficient protective measures, such as monitoring for vibration control, to ensure that no damage to the retaining wall results from the construction works. The report must be submitted to AMO for approval before construction activities commence. Upon approval the appropriate monitoring and precautionary measures shall be put into place.</p> | ^ |
| | <p>A buffer zone with a minimum width of 3 metres and an obstruction free access point must be maintained between the retaining wall and the temporary works area (for the duration of the construction phase). The works area will be enclosed by standard DSD site hoarding.</p> | ^ |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

| Types of Impacts | Mitigation Measures | Status |
|-----------------------|---|--------|
| Fisheries | Silt curtain will be deployed during the construction and demolition of the temporary berthing point. With the deployment of silt curtains around the berthing point area, adverse water quality impact associated with the filling would not be anticipated. No significant fisheries impact is anticipated. | N/A |
| | The invert of stilling basin will be found at -5.4 mPD. A cofferdam in the form of pipe-pipe wall is to be constructed outside the stilling basin prior to the construction of basin. The cofferdam will be dewatered to provide a working space for the construction of stilling basin. The boulders from the seawall will then be removed by landbased grabs. | ^ |
| Hazard to Life | There will be no overnight storage of explosives for this project. Transportation of explosives to site for the construction of adit will be undertaken on a daily basis. The contractor is required to destroy any unused explosives before nightfall. If contractor wishes to set up magazines for overnight storage of explosives, it is necessary to carry out risk assessment and seek the relevant approval following the EIAO process. | ^ |

Remarks: ^ Compliance of mitigation measure; X Non-compliance of mitigation measure;
N/A Not Applicable at this stage; • Non-compliance but rectified by the contractor;
* Recommendation was made during site audit but improved/rectified by the contractor;
Non-compliance but rectified/improved by the contractor and awaiting IEC's further comment.

APPENDIX G
SITE AUDIT SUMMARY

Appendix G Summary of Observation and Recommendation Made during Site Inspection

Summary of Observation and Recommendation Made during Site Inspection in April 2013

| Parameters | Date | Observations and Recommendations | Follow-up |
|-----------------------------------|-------------|---|--|
| Waste/Checmical Management | 11/04/2013 | Drip tray should be provided to chemical container at P5. | Rectification/improvement was observed during the follow-up audit session. |
| Reminder | 03/04/2013 | Provide sand bag bunding to gullies at Intake P5. | Rectification/improvement was observed during the follow-up audit session. |

Summary of Observation and Recommendation Made during Site Inspection in May 2013

| Parameters | Date | Observations and Recommendations | Follow-up |
|-------------------|-------------|---|------------------|
| N/A | N/A | N/A | N/A |

Summary of Observation and Recommendation Made during Site Inspection in June 2013

| Parameters | Date | Observations and Recommendations | Follow-up |
|-------------------|-------------|---|------------------|
| N/A | N/A | N/A | N/A |

**APPENDIX H
SUMMARY STATUS OF
ENVIRONMENTAL LICENCES AND
PERMITS**

Appendix H - Summary of Environmental Licensing and Permit Status

| Permit No. | Valid Period | | Details | Status |
|----------------------------|--------------|----------|--|--------|
| | From | To | | |
| Environmental Permit (EP) | | | | |
| FEP-01/272/2007/B | 25/6/09 | N/A | Construction of a 6.25m-7.25m in diameter and about 11 km long underground main drainage tunnel, 2 portals and a series of connecting adits and drop shafts. | Valid |
| Effluent Discharge License | | | | |
| EP860/W10/XY0175 | 23/06/08 | 30/06/13 | Industrial discharge (Area of Mount Butler Office) | Valid |
| EP860/W10/XY0177 | 23/06/08 | 30/06/13 | Industrial discharge (Eastern Portal Site) | Valid |
| EP820/W9/XT086 | 22/07/08 | 31/07/13 | Industrial discharge (Western Portal Site) | Valid |
| WT00005864-2010 | 20/01/10 | 31/01/15 | Industrial discharge (Western Portal Site) | Valid |
| EP860/W10/XY0183 | 19/11/08 | 30/11/13 | Industrial discharge (Intake W0, Stubbs Road, Wan Chai, HK) | Valid |
| WT00003737-2009 | - | 31/5/14 | Industrial discharge (Intake MB16) | Valid |
| WT00004126-2009 | | 31/5/14 | Industrial discharge (Intake HKU1) | Valid |
| WT00003738-2009 | - | 31/5/14 | Industrial discharge (Intake THR2) | Valid |
| WT00004270-2009 | - | 31/7/14 | Industrial discharge (Intake PFLR1) | Valid |
| WT00004806-2009 | - | 30/09/14 | Industrial discharge (Intake E7) | Valid |
| WT00004808-2009 | - | 30/09/14 | Industrial discharge (Intake MBD2) | Valid |
| WT00004885-2009 | - | 30/09/14 | Industrial discharge (Intake RR1) | Valid |
| WT00005135-2009 | - | 31/10/14 | Industrial discharge (Intake W10) | Valid |
| WT00005374-2009 | - | 30/11/14 | Industrial discharge (Intake P5) | Valid |
| WT00005376-2009 | - | 30/11/14 | Industrial discharge (Intake TP4) | Valid |
| WT00005357-2009 | - | 30/11/14 | Industrial discharge (Intake W5) | Valid |
| WT00005588-2009 | - | 31/12/14 | Industrial discharge (Intake TP5) | Valid |
| WT00005643-2009 | - | 31/12/14 | Industrial discharge (Intake E5A) | Valid |
| WT00005754-2010 | - | 31/01/15 | Industrial discharge (Intake W8) | Valid |
| WT00005954-2010 | - | 28/02/15 | Industrial discharge (Intake TP789) | Valid |
| WT00005915-2010 | - | 31/01/15 | Industrial discharge (Intake E5B) | Valid |
| WT00006102-2010 | - | 28/02/15 | Industrial discharge (Intake M3) | Valid |
| WT00006415-2010 | - | 30/04/15 | Industrial discharge (Intake MA15) | Valid |
| WT00006420-2010 | - | 30/04/15 | Industrial discharge (Intake MA17) | Valid |
| WT00006428-2010 | - | 30/04/15 | Industrial discharge (Intake BR6) | Valid |
| WT00006609-2010 | - | 31/05/15 | Industrial discharge (Intake HR1) | Valid |
| WT00006559-2010 | - | 30/04/15 | Industrial discharge (Intake CR1) | Valid |

| Permit No. | Valid Period | | Details | Status |
|--|--------------|----------|---|--------|
| | From | To | | |
| WT00006929-2010 | - | 30/06/15 | Industrial discharge (Intake W1) | Valid |
| WT00006418-2010 | - | 30/06/15 | Industrial discharge (Intake MA14) | Valid |
| WT00006865-2010 | - | 30/06/15 | Industrial discharge (Intake BR5) | Valid |
| WT00007039-2010 | - | 31/07/15 | Industrial discharge (Intake DG1) | Valid |
| WT00007042-2010 | - | 31/07/15 | Industrial discharge (Intake W3) | Valid |
| WT00007043-2010 | - | 31/07/15 | Industrial discharge (Intake GL1) | Valid |
| WT00007130-2010 | - | 31/07/15 | Industrial discharge (Intake BR4) | Valid |
| WT00007139-2010 | - | 31/07/15 | Industrial discharge (Intake BR6) – SMH17 | Valid |
| WT00007319-2010 | - | 31/08/15 | Industrial discharge (Intake B2) | Valid |
| Registration of Chemical Waste Producer | | | | |
| 5213-148-D2393-02 | --- | N/A | Chemical waste types: Spent oil | Valid |
| 5213-172-D2393-01 | --- | N/A | Chemical waste types: Spent oil | Valid |
| Construction Noise Permit (CNP) | | | | |
| N/A | | | | |

APPENDIX I
WASTE GENERATED QUANTITY

Monthly Waste Flow Table

| Quarter ending | Actual Quantities of Inert C&D Materials Generated Monthly ^{(1) (3)} | | | | | | Actual Quantities of C&D Wastes Generated Monthly | | | | |
|--------------------------|---|--------------------------------|------------------------|---|-------------------------|-----------------------|---|----------------------------|-------------------------|----------------|-----------------------------|
| | Total Quantity Generated | Broken Concrete ⁽⁸⁾ | Reused in the Contract | Reused in other Projects ^{(4) (5)} | Disposed as Public Fill | Imported Fill | Metals | Paper/ cardboard packaging | Plastics ⁽²⁾ | Chemical Waste | Others, e.g. general refuse |
| | (in m ³) | (in m ³) | (in m ³) | (in m ³) | (in m ³) | (in m ³) | (in Kg) | (in Kg) | (in Kg) | (in Kg) | (in m ³) |
| Jan-13 | 153 | 14 | 0 | 0 | 139 | 0 | 89080 | 3170 | 0 | 1200 | 207 |
| Feb-13 | 91 | 0 | 0 | 0 | 91 | 0 | 0 | 1210 | 0 | 0 | 22 |
| Mar-13 | 200 | 77 | 0 | 0 | 123 | 0 | 38960 | 960 | 0 | 0 | 45 |
| Apr-13 | 29 | 0 | 0 | 0 | 29 | 0 | 0 | 0 | 0 | 0 | 78 |
| May-13 | 134 | 67 | 0 | 0 | 67 | 0 | 0 | 240 | 0 | 0 | 22 |
| Jun-13 | 22 | 0 | 0 | 0 | 22 | 0 | 0 | 0 | 0 | 0 | 0 |
| Sub-Total | 629 | 158 | 0 | 0 | 471 | 0 | 128040 | 5580 | 0 | 1200 | 374 |
| Jul-13 | 50 | 0 | 0 | 0 | 50 | 0 | 0 | 0 | 0 | 0 | 10 |
| Aug-13 | 50 | 0 | 0 | 0 | 50 | 0 | 0 | 0 | 0 | 0 | 10 |
| Sep-13 | 50 | 0 | 0 | 0 | 50 | 0 | 0 | 0 | 0 | 0 | 10 |
| Oct-13 | 50 | 0 | 0 | 0 | 50 | 0 | 0 | 0 | 0 | 0 | 10 |
| Nov-13 | 50 | 0 | 0 | 0 | 50 | 0 | 0 | 0 | 0 | 0 | 10 |
| Dec-13 | 50 | 0 | 0 | 0 | 50 | 0 | 0 | 0 | 0 | 0 | 10 |
| Total ^{(6) (7)} | 629 | 158 | 0 | 0 | 471 | 0 | 128040 | 5580 | 0 | 1200 | 374 |

Notes:

- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (2) Plastics refer to plastic bottles/containers, plastic/foam from packaging material.
- (3) Quantities in Jun 01, 2013 are upto Jun 30, 2013
- (4) Assuming the conversion factor from m³ to ton for rock is 2.5.
- (5) The materials reused in other Project shall not be treated as waste under the Waste Disposal Ordinance (Cap 354).
- (6) The figures are included for the sake of completeness of record.
- (7) The figures in blue font are the prediction quantities, which are not included in the "Total" quantities.
- (8) Unless states otherwise, the broken concrete is disposed as public fill in PFRFs.

APPENDIX J
SUMMARY OF EXCEEDANCES

Contract No. DC/2007/10 – Design and Construction of Hong Kong West Drainage Tunnel

Exceedance Report

Eastern Portal

- (A) Exceedance Report for Air Quality (1 hour TSP)**
(NIL in the reporting quarter)
- (B) Exceedance Report for Air Quality (24 hours TSP)**
(NIL in the reporting quarter)
- (C) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Western Portal

- (D) Exceedance Report for Air Quality (1 hour TSP)**
(NIL in the reporting quarter)
- (E) Exceedance Report for Air Quality (24 hours TSP)**
(NIL in the reporting quarter)
- (F) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intakes

Intake BR6

- (G) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake DG1

- (H) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake E5A

- (I) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake E7

- (J) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake MA14

- (K) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake PFLR1

- (L) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake RR1

- (M) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake W0

- (N) Exceedance Report for Construction Noise**
(NIL in the reporting quarter)

Intake W5

(O) Exceedance Report for Construction Noise
(NIL in the reporting quarter)

Intake W8

(P) Exceedance Report for Construction Noise
(NIL in the reporting quarter)

Intake P5

(Q) Exceedance Report for Construction Noise
(NIL in the reporting quarter)

**APPENDIX K
COMPLAINT LOGS**

APPENDIX K – COMPLAINT LOG

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|---------------|---|---|--------|
| Com-2008-05-003 | Construction site at Eastern Portal | 22 May 2008 | The complaint was lodged by a complainant on 22 May 2008 regarding noise nuisance generated from the construction activities at the construction site of Eastern Portal | <p>According to the Contractor, only one excavator and one generator were operated for the excavation works around 8 am on 22 May 2008 at the Eastern portal. No other construction activities were conducted.</p> <p>In response to the complaint, The Contractor agreed to reschedule their current works activities, with immediate effect from 23 May 2008, that only site preparation works without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at the Eastern Portal area.</p> <p>Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in May and (2) no non-compliance or observation on noise was recorded.</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|--|---------------|--|---|--------|
| | | | | | |
| Com-2008-05-004 | Construction site at Western Portal (Marine Works) | 31 May 2008 | The complaint was lodged by one of the local resident on 31 May 2008 regarding the noise nuisance generated from the marine works at Western Portal. | <p>According to the Contractor, only two derrick barges and one tug boat were operated for the seabed formation works around 18:00 hrs on 31 May 2008 at the Western Portal. No other construction activities were conducted.</p> <p>Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in May and (2) no non-compliance or observation on noise was recorded.</p> | Closed |
| Com-2008-07-007 | Construction site at Eastern Portal | 2 July 2008 | The complaint was lodged by a resident of The Legend on 2 July 2008 regarding noise nuisance generated from the construction activities at the construction site of Eastern Portal | <p>According to the Contractor, only one generator and one drilling rig (Jumbo) were operated for the preparation works around 7:30a.m on 2 July 2008 at the Eastern portal. Construction noise was found from other construction site (Gammon Construction Limited) adjacent to Eastern Portal area.</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|----------|----------|---------------|----------------------|---|--------|
| | | | | <p>In response to the complaint, The Contractor review his forthcoming operations within the Eastern Portal site as previous they agreed, reschedule their current works activities, with immediate effect from 23 May 2008, that only site preparation works without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at the Eastern Portal area.</p> <p>Additional noise monitoring was conducted on 16 and 17 July 2008 during the drilling rig (Jumbo), excavator and wheel loader were operated for drilling works.</p> <p>Base on the information collected and the monitoring results, the complaint was considered not justifiable since (1) no exceedance of the noise monitoring results was recorded in June and July 2008 and additional noise monitoring (2) no non-compliance or observation on noise was recorded.</p> | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|-----------------|---|--|--------|
| COM-2008-10-011 | Construction site at Western Portal | 11 October 2008 | The complaint was lodged by one of the resident of Victoria Road on 11 October regarding about the noise nuisance generated from the construction works at Western Portal | <p>According to the Contractor, excavation works and marine works including sheet piling works were also conducted at the time of complaint at Western Portal</p> <p>Additional noise monitoring was conducted on 15 October 2008, drilling works, excavation works and marine works including sheet piling works were also conducted. The construction noise levels measured during the construction works were well below the construction noise limit of 75 dB(A)</p> <p>The Contractor agreed to reschedule the starting time of the construction works to 8:15am on every Saturday that without noise nuisance from the construction works to the nearby residents will be carried out from 7:00 am to 8:15 am at the Western Portal area.</p> <p>Base on the information collected, the noise level measured at outside Aegean Terrace during the construction works at Western Portal site were well below the construction</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|---------------------------------|-----------------|--|--|--------|
| | | | | noise limit of 75 dB(A). Also, the Contractor has implemented the remedial measure that reschedule the starting time of the construction works to 8:15am on every Saturday immediately after receiving the complaint to minimize the noise nuisance to the nearby residents. | |
| COM-2008-10-012 | Construction site at Intake TP5 | 15 October 2008 | The complaint was lodged by a complainant on 15 October 2008 regarding about the noise generated from the GI works, which starts from 8:30 hrs to 17:30 hrs next to Aigburth at May Road. | According to the information provided by the Contractor, only rotary type drill rigs and water pumps were operated for the GI works at the time of complaint at Intake TP5. | Closed |
| COM-2008-10-013 | Construction site at Intake TP5 | 31 October 2008 | The complaint was lodged by a complainant on 31 October 2008 regarding the black smoke is emitted and noise is generated from the machine at the site (Intake TP5), he needed to close the windows to prevent the black smoke from entering his flat and to attenuate the noise. | Additional site inspection and noise monitoring at the podium of the Valverde at May Road were conducted on 3 Nov 2008 and 24 Oct, 5 Nov, 7 Nov 2008 respectively. The Contractor agreed to reschedule the starting time of the construction works to 9:30am on every Saturday and 8:00 on normal weekdays that | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|------------------|--|---|--------|
| COM-2008-11-015 | Construction site at Intake TP5 | 4 November 2008 | The complaint was lodged by a complainant on 4 November regarding the noise nuisance generated from the construction works at Intake TP5. | without noise nuisance to the nearby residents will be carried out from 7:00 am to 8:00 am at Intake TP5. Acoustic insulating materials have been applied for enclosing water pump and rotary type drill rigs to minimize the noise nuisance to the nearest residents. Base on the information collected, the noise level measured at the podium of the Valverde at May Road were well below the construction noise limit of 75 dB(A) after the Contractor has implemented the remedial measure. | |
| COM-2008-11-016 | Construction site at Western Portal | 17 November 2008 | The complaint was lodged by a complainant on 17 November 2008 regarding dust nuisance arising from the soil nailing works at the roadside slope of Cyberport | According to the information provided by the Contractor, soil nailing works were conducted and some plant equipments i.e air compressor and generator were operated at the time of complaint at Western Portal. Base on the regular air quality monitoring in November 2008 at Outside Aegean Terrace (AQ2) and Outside The Site Office at Western | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|------------------|---|---|--------|
| | | | Road. | Portal (AQ3), the dust levels measured at AQ2 for 1 hour TSP and at AQ3 for 24 hour TSP were well below the Action Level (321µg/m ³ for 1 hour TSP and 156µg/m ³ for 24 hour TSP). Also, the Contractor has implemented the dust suppression measures to prevent dust nuisance from the construction activities including soil nailing works. | |
| COM-2008-11-019 | Construction site at Western Portal | 29 November 2008 | The complaint was lodged by a complainant on 1 December 2008 regarding noise nuisance at Western Portal at 08:30 hrs approx on 29 November 2008 and 00:30 on 1 December 2008. | <p>According to the information provided by The Contractor, no construction works was carried out at the temporary jetty at the time of complaint (00:30 on 1 December 2008) at Western Portal.</p> <p>However, base on the regular noise monitoring at Outside Aegean Terrace (NC3), the noise level measured during the construction works at Western Portal site were well below the construction noise limit of 75 dB(A).</p> | Closed |
| | Construction site at Western Portal | | | The complaint was considered not justifiable as Construction Noise Permit (CNP) – CNP No. GW-RS0827-08 has been granted from | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|---|------------------|---|---|--------|
| COM-2008-12-020 | | 28 December 2008 | The complaint was lodged by a complainant on 28 December 2008 regarding the excavator was found working within Western Portal works area on Sunday. | EPD for carrying out the construction works at Hong Kong West Drainage Tunnel (Western Portal), Cyberport Road, Cyberport, Hong Kong (DSD Contract No. DC/2007/10) between 1 December 2008 at 1900 hours and 28 February 2009 at 2400 hours. The powered mechanical equipment can be operated during the hours as below: a) Any day not being a general holiday between 1900 – 2300 hours b) General holiday (including Sundays) between 0700 – 1900 hours | |
| COM-2009-01-021 | Muddy Water Discharged into Sea at Western Portal | 21 January 2009 | Muddy water was observed from discharging into the sea at Western Portal Site | Base on the information collected, the muddy water discharged into the sea is considered due to the operations of excavation of stilling basin and poor condition of the silt curtain. The Contractor agreed to review their current provisions to prevent any muddy water from discharging into the sea again and close check the | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|--------------------|-------------------------------------|-----------------|--|---|--------|
| | | | | condition of the silt curtain. | |
| COM-2009-01-022(A) | Construction site at Western Portal | 12 January 2009 | The complaint was lodged by a complainant, the assistant of Southern District Councillor about the resident in Baguio Villa near Victoria Road, the complainant concerns on the noisy activities carried out at Western Portal site. | Base on the information collected, the noise level measured at outside Aegean Terrace during the construction works at Western Portal site were well below the construction noise limit of 75 dB(A). Aegean Terrace is at location close to the major site activities compared with Baguio Vila. Also, The Contractor agreed to reschedule their current works activities, no noisy work will be carried out at Western Portal Site before 8:00a.m. | Closed |
| COM-2009-01-022(B) | | 21 January 2009 | The complaint was lodged by resident of Aegean Terrace at Sassoon Road about the noise nuisance generated from Western Portal Site. | | |
| COM-2009-01-022(C) | | 21 January 2009 | The complaint was lodged by the resident in Baguio Villa near Victoria Road about noisy works at Western Portal Site. | | |
| COM-2009-02-023 | Construction site at Eastern Portal | 7 February 2009 | Complaint of Construction Noise at Early Morning (07:45hrs) at Eastern Portal | Based on the information collected, the construction noise at about 07:45hrs on 7 February 2009 was due to the checking of the backhole by the sub-contractor. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|------------------------------|---|---|--------|
| | | | Site | The Contractor was reminded to strengthen their site supervision and provide sufficient site-specific environmental training for sub-contractor to ensure that such situation would not be recurred. | |
| COM-2009-03-025 | Construction site at Western Portal | 2 March 2009 4 March 2009 | Complaint of noise generated by midnight works and night-time lighting at Western Portal Site | Base on the information collected, the regular noise monitoring was conducted during the construction works at the restricted hours. The noise measurement results were well below the construction noise limit of 65dB(A) for the period of 0700-2300 hrs on holiday; and 1900-2300 hrs on all other days and baseline level during the night time. | Closed |
| COM-2009-03-026 | | 7 March 2009 | Complaint of pipe hitting noise at midnight at Western Portal Site. | <p>The Contractor was reminded to strengthen their site supervision and implement necessary noise mitigation measures to minimize and avoid the construction noise impact to the residents nearby especially during the restricted hours.</p> <p>Regarding the complaint of spotlight hanging on the plant at the site portion WP, The Contractor was reminded to implement the</p> | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|---------------|--|--|--------|
| | | | | mitigation measures for Visual during the construction by controlling the night-time lighting so that the residual visual impacts can be accepted. | |
| COM-2009-04-028 | Construction site at Western Portal | 7 April 2009 | Complaint of noise generated from the construction works conducted till 11:00pm at Western Portal of the Hong Kong West Drainage Tunnel. | According to the information provided by The Contractor, TBM, conveyor belt, ventilation fan, tower crane and cherry picker were operated for the construction works on 7 April 2009 before 11:00pm and only TBM works with conveyor belt and ventilation fan were operated on 10 April 09 (Sunday). No operation of derrick barge on 10 April 09. | Closed |
| COM-2009-04-029 | | 10 April 2009 | Complaint of noise generated by TBM works at Western Portal. | <p>According to the photos taken on 8 April 2009, misplacement of plant was observed at Western Portal Site. Upon advice, The Contractor immediately moved the fan properly.</p> <p>Based on the information collected, the construction noise levels measured were well below the construction noise limit of 75 dB(A) for the period of 0700-1900 hrs on normal weekdays, 65 dB(A) for the</p> | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|----------|----------|---------------|----------------------|---|--------|
| | | | | <p>period of 0700-2300 hrs on holiday; and 1900-2300 hrs on all other days and baseline level for the period of 2300-0700 hrs of next day. The ground borne noise levels measured were also well below the construction ground borne noise standards (i.e. 65 dB(A) – Daytime (except General Holiday and Sundays) and 55 dB(A) – Daytime during general holidays and Sunday and all days during Evening (1900 to 2300 hrs). No exceedances of noise level have been recorded in March and April 2009.</p> <p>The Contractor was advised to strictly follow the conditions of the permit to avoid any misplacement of plants in the future. Also, The Contractor should take sufficient noise mitigation measures to minimize the environmental impact on the nearby community as recommended in the approved EIA report.</p> <p>In addition, DNJV already arranged tailors made training for the Production Team including the</p> | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|----------|----------|---------------|----------------------|---|--------|
| | | | | senior management and foreman to explain the conditions and requirements listed on the CNP and delegated one Engineer to ensure all construction activities and PME's to be used are fully complying with CNP and legislation requirements before the commencement of the construction activities during the restricted hour. | |
| | | | | <p>Base on the information collected, regular noise Monitoring was conducted during the night time to check the noise levels are complying with the construction noise criteria. The noise levels measured at NC3 during the construction works at night time were well below the construction noise limit.</p> <p>The Contractor was reminded to strengthen their site supervision by delegated Engineer to ensure all construction activities and PME's to be used are fully complying with CNP and legislation requirements and implement necessary noise mitigation measures as</p> | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|---------------|--|--|--------|
| | | | | recommended in the Approved EIA report to minimize and avoid the construction noise impact to the residents nearby especially during the restricted hours. | |
| COM-2009-04-030 | Construction site at Western Portal | 30 April 2009 | Complaint of Construction Noise Generated at Night at Western Portal. | According to the site activities diaries, TBM chainage, TBM excavation, installation of segment ring, pea gravel & mortar injection and installation cables & pipes at gantries were the activities conducted in the night of 30 April 2009. | Closed |
| COM-2009-05-031 | | 4 May 2009 | Complaint of low frequency noise emitted from the construction site at Western Portal. | In accordance with the night time visit on 15 May 2009, the noise levels at Aegean Terrace was not high but with occasionally sound of locomotive and tower crane operations. | |
| | | 11 May 2009 | Complaint of Construction Noise nuisance generated from the Western Portal Site from day to night. | No exceedance of noise level was recorded since the commencement of the project works at Western Portal Site. The noise levels measured at NC3 during the construction works were well below the construction noise limit. The Contractor will continue | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|---|---------------|--|---|--------|
| | | | | implementing their mitigation measures (e.g. Instruct workers not to shout during work in the evening; no horn signal of locomotive after 6:55 pm). | |
| COM-2009-05-032 | Construction site at Eastern Portal | 13 May 2009 | The complaint was lodged by a resident regarding the Construction Noise Nuisance from the construction works that were carried out from early morning till night time at Eastern Portal Site Area. | Based on the information collected, the noise levels measured at NC1/NC1a and NC2 during the construction works were well below the construction noise limit or baseline level. The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents especially during the restricted hours. | Closed |
| COM-2009-06-035 | Hong Kong West Drainage Tunnel Construction Site at Cyberport | 3 June 2009 | EPD received a public complaint raised by local resident regarding the transportation and disposal of construction wastes from Hong Kong West Drainage Tunnel Construction Site at Cyberport on 3 June 2009. | Base on the information collected, alternative disposal ground is proposed by The Contractor and they have been submitted the relevant information and sought the approval from Supervising Officer. The Contractor also maintains the daily record with details of each disposal trip from the Site and the disposal ground. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|----------------|--|---|--------|
| COM-2009-06-037 | Construction site at Eastern Portal | 23 June 2009 | The few noise complaints were lodged by a resident of The Legend and Ronsdale Garden regarding the Construction Noise Nuisance from the construction works at Eastern Portal Site Area since 7:00a.m and in the afternoon. | Based on the information collected, the noise levels measured at NC1 and NC2 during the construction works were well below the construction noise limit or baseline level. | Closed |
| COM-2009-06-038 | | | The complaint was raised by a representative of Goodwell Property Management, she wrote on behalf of the Estate Owner Committee of Legend at Tai Hang about noise nuisance arising from the excavation works at Eastern Portal site portion. The Committee requested the Contractor to provide mitigation measures to minimise the impact. | In response to the complaints, the head of hydraulic breaker has been wrapped with sound proof materials and movable noise barriers were provided for rock excavation to reduce noise. The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents. | |
| COM-2009-08-040 | Construction site at Intake PFLR1 | 26 August 2009 | The complaint was relating to the noise generated from the construction activities of breaking of the existing boundary wall of Pokfulam Road Playground by use of | Noise monitoring results conducted on 1 September 2009 at NC11 - Honey Court for the Intake PFLR1 was submitted and no exceedance was recorded. In addition, based on the regular site inspection conducted | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|-------------------|---|---|--------|
| | | | the hand-held electric breaker. | at Intake PFLR1, no observation/non-compliance on air quality was identified. The environmental conditions of the site will be continuously reviewed and monitored. DNJV had installed tarpaulin shielding and cover to mitigate not only the potential emission of exhausted smoke, but also the visual impact to the residents nearby. | |
| COM-2009-09-042 | Construction site at Eastern Portal | 21 September 2009 | The complaint was raised by a resident of The Legend regarding poor housekeeping and construction noise nuisance from the Eastern Portal Site Area. | Based on the information gathered in the Investigation, the Contractor had taken action immediately to rectify the complaint of poor housekeeping. The white site office was painted green in harmony with the surrounding environment and the site was maintained in a clean and tidy condition. All materials required for temporary works were stored in an orderly manner. Regarding the complaint of construction noise impact, the noise levels measured at The Legend | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|----------------------|---|---|--------|
| | | | | <p>(NC2) during the construction works in the normal working hours were well below the construction noise limit level.</p> <p>Nevertheless, the Contractor is also committed to implementing sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents and provide training for the workers to increase awareness of their environmental responsibilities.</p> | |
| COM-2009-10-044 | Construction site at Eastern Portal | 6 and 7 October 2009 | The complaint was raised by a resident of The Legend and Ronsdale Garden regarding the construction noise nuisance from the Eastern Portal Site Area. | <p>Based on the information gathered in the Investigation, the noise levels measured (additional noise monitoring) at The Legend (NC2) and Ronsdale Garden during the construction works including rock breaking works and soil nailing works were ranged from 68.4dB(A) to 75.3 dB(A) in the normal working hours.</p> <p>The Contractor is committed to implementing sufficient noise mitigation measures as</p> | Closed |
| COM-2009-10-045 | | | | | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------------------------------|-------------------------|---|---|--------|
| | | | | <p>recommended in the approved EIA report to minimize the nuisance caused to the nearby residents and provide training for the workers to increase awareness of their environmental responsibilities.</p> <p>It is recommended to increase the construction noise monitoring frequency for Eastern Portal Site to check the mitigation effectiveness.</p> | |
| COM-2009-11-054 | Construction site at Western Portal | 23 and 29 November 2009 | The complaint was raised by a resident of Aegean Terrace regarding the construction noise nuisance from the Western Portal Site Area. | Base on the information collected, the noise levels measured at NC3 during the construction works were well below the construction noise limit. | Closed |
| | | | | Nevertheless, the Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report, Clause 5.4.15 to minimize/avoid the nuisance caused to the nearby residents. | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-----------------------------------|-------------------------|--|---|--------|
| COM-2009-12-059 | Construction site at Intake MB16 | 27 November 2009 | The complaint was received on 2 November 2009 regarding the dust nuisance caused by the works at the Construction Site at Mount Butler Road near Clementi Road (Intake MB16). EPD subsequently issued a notice of complaint. | Based on the information collected, the Contractor has implemented the dust suppression measures to prevent dust nuisance from the construction activities. During the site inspection in November 2009, slope improvement works including soil nailing works were observed from other construction site adjacent to DNJV's construction works at Mount Butler Road. | Closed |
| COM-2009-12-061 | Construction site at Intake PFLR1 | 23 and 28 December 2009 | Two public complaints were received from the resident of Pok Fu Lam Road on 23rd and 28th December 2009 respectively about the construction noise nuisance from the construction site at Intake PFLR 1. | Based on the information gathered in the Investigation, the noise levels measured at Honey Court (NC11) during the construction works were well below the construction noise limit. The location of the designated noise monitoring station (NC11 – Honey Court) is at location close to the construction site compared with Pok Fu Lam Height. In addition, a large scale innovation works being undertaken at a resident building adjacent to the Pok Fu Lam Height was observed during the | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|---|-------------------------------------|---|--|---|--------|
| | | | | routine site inspection. The innovation works included hammering and drilling on the outer walls of the building and contributed significantly to the noisy environment. | |
| COM-2010-01-062 | Construction site at Western Portal | 3 January 2010 | The public complaint was received from the resident of Bel-Air through the project hotline on 3rd January 2010 about “wooning” sound heard after midnight, and he suspected that the sound was coming the construction sites at Cyberport. | Base on the information collected, the noise levels measured at NC3 during the construction works were well below the baseline level. The location of the designated noise monitoring station (NC3 – Outside Aegean Terrace) is at location close to the construction site compared with Bel-Air. The Contractor will continue implementing the existing noise mitigation measures at the Western Portal to minimize the environmental impact to the nearby residents. | Closed |
| COM-2010-01-063 COM-2010-01-066(1), (2) and (3) | Intake MB16 | 20 January 2010 23, 25, 27 January and 2 February 2010 | The first complaint was raised by the resident at No. 58 Mount Butler Road about the noise and vibration generated from the works on 20 January 2010. Three complaints were raised | Based on the EIA assessment results, No. 58 Mount Butler Road and Amber Lodge are not the potential ground borne noise sensitive receivers as they are not within the influence zone near the Main Tunnel alignments from Cyberport to Tai Hang and the alignments of the adits. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|-----------------|---|---|--------|
| | | | by the resident of Amber Lodge through the Project Hotline regarding the low frequent vibration from underground on 23, 25, 27 January and 2 February 2010. | <p>The additional ground borne noise levels measured at inside Amber Lodge during the TBM works were well within the construction ground borne noise standards.</p> <p>The Contractor volunteered to stop the operation of the East TBM between midnight and 07:00 hours in Week 6 and 7 after which the machine has moved far away from these premises</p> | |
| COM-2010-02-073 | Western Portal | 3 February 2010 | Complaint of noise generated by the operation of plants, rock falling and flash lighting within Western Portal site area. | <p>Base on the regular noise monitoring, the noise levels measured at NC3 during the construction works were well below the baseline level.</p> <p>The Contractor will continue implementing the existing noise mitigation measures at the Western Portal to minimize the environmental impact to the nearby residents.</p> | Closed |
| COM-2010-03-080 | Intake PFLR1 | 1 March 2010 | The public complaint was received from the resident of Honey Court referred by a DC member on 1st March 2010 about the construction | Based on the information gathered in the Investigation, the noise levels measured at Honey Court (NC11) in February and March 2010 were ranged from 62.3 dB(A) to 74.7 | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|--------------|---------------|--|--|--------|
| | | | noise nuisance from the construction site at Intake PFLR 1 | <p>dB(A). The noise levels were marginally below the 75dB (A) limit level.</p> <p>The contractor was reminded to implement necessary mitigation measures to curb inducing contribution to the surrounding noise environment.</p> | |
| COM-2010-03-081 | Intake TP789 | 5 March 2010 | The complaint was received from Kerry Management Ltd. on 5th March 2010 about the construction noise complaints raised by some tenants of Tavistock. They complained about the noisy activities being carried out at Intake TP789 on Saturday. | <p>Based on the information gathered in the investigation, the noise levels measured at Tregunter Path near Tavistock were below the construction noise limit and the Contractor has already implemented the noise mitigation measures to reduce noise impact to the residents arising from the construction works.</p> <p>Nevertheless, we reminded the Contractor to closely monitor the effective implementation of the existing noise mitigation measures at Intake TP789. Review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|--|----------------|-------------------------------|---|---|--------|
| COM-2010-03-082 and COM-2010-03-087 | Western Portal | 6 March 2010 15 March 2010 | Two public complaints were received from the residents of Bel-Air at Western Portal on 6th and 15th March 2010 about the Construction Noise and Dust Nuisance from Hong Kong West Drainage Tunnel Construction Site at Cyberport (i.e. Western Portal Site) respectively. | Based on the information collected, the noise and air quality levels measured at NC3 and AQ2/AQ3 during the construction works were below the noise and air quality criteria respectively. Also, the Contractor has implemented appropriate environmental mitigation measures on site to reduce noise and dust impact to the residents arising from the construction works. Nevertheless, the Contractor was reminded to review the effectiveness of the implemented noise and air quality mitigation measures from time to time during different construction phases. | Closed |
| COM-2010-04-094 | Western Portal | 9 April 2010 | The public complaint was received by EPD hotline on 9 th April 2010 regarding construction dust nuisance from the Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site) | Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria. Also, the Contractor has implemented appropriate dust mitigation measures on site to reduce dust impact to the residents arising from the construction works. Although the air quality levels measured at AQ2 and | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|------------------|---------------|---|--|--------|
| | | | | <p>AQ3 were below the air quality criteria, we advised the Contractor to maintain the existing air quality mitigation measures, to reduce the environmental impact on the nearby residents.</p> <p>Nevertheless, the Contractor was reminded to review the existing measures if such measures are enough and appropriate to suit the site condition from time to time during different construction phases to minimize the dust nuisance.</p> | |
| COM-2010-04-097 | Intake TP789/TP4 | 22 April 2010 | The complaint was received from resident of Tregunter Tower on 22 nd April 2010 about the noisy activities being carried out at Intake TP789/TP4 in the morning. | <p>Based on the information gathered in the investigation, the noise levels measured at Tregunter Path near Tavistock were below the construction noise limit and the Contractor has further improved the noise mitigation measures to reduce noise impact to the residents arising from the noise generation works.</p> <p>The Contractor agreed to reschedule the starting time of the noisy works to 9:00am on in the morning that no noisy works such as rock breaking</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|---|---|--------|
| | | | | will be conducted before 9:00am. In addition, enclosures consist of noise absorption blankets have been applied for enclosing Intakes construction areas to minimize the noise nuisance to the nearest residents. | |
| COM-2010-04-100 | Western Portal | 30 April 2010 | The public complaint was received from the resident of Bel-Air on 30 th April 2010 regarding the dust nuisance generated during loading / unloading operation from two barges at pier of Cyberport. Dark smoke was also emitted from the two barges. | <p>Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria.</p> <p>The Contractor has taken initiative to minimize dust nuisance to the nearby residents by implementation of additional mitigation measures as below:</p> <ul style="list-style-type: none"> - To plan the installation of 3-sided curtain-like enclosure at the conveyor discharge point to the barge. - Mechanical cover closed even for empty trucks leaving the Site. - Written advice to subcontractor on the subject of dust suppression and speeding of vehicles. - Toolbox training to drivers on the new measures. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|---------------------|----------------|---------------|--|---|--------|
| COM-2010-05-105 | Western Portal | 7 May 2010 | The second complaint was received via EPD Hotline on 7 May 2010. The anonymous complainant concerned about the dark smoke emitted from the barges on 4 May 2010 and many dump trucks parking outside the Western Portal Site on 5, 6 and 7 May 2010. | Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the air quality criteria. | Closed |
| COM-2010-05-105 (2) | | 17 May 2010 | The complaint was received via EPD Hotline on 17 May 2010. The anonymous complainant complaint about the open stockpile of dusty materials without covered entirely. | <p>Although the air quality levels measured at AQ2 and AQ3 were below the air quality criteria, we advised the Contractor to maintain the existing air quality mitigation measures and review the existing measures if such measures are enough and appropriate to suit the site condition from time to time during different construction phases to minimize the dust nuisance.</p> <p>Other suitable dust control measures as stipulated in the Air Pollution Control (Construction Dust) Regulation, where appropriate, should be adopted.</p> <p>Nevertheless, the Contractor is also committed to take sufficient dust mitigation measures as recommended in the approved EIA report including</p> | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|--|---|--------|
| | | | | installation of 3-sided curtain-like enclosure at the conveyor discharge point to the barge to minimize the dust nuisance on the nearby residents. | |
| COM-2010-06-113 | Intake PFLR1 | 2 June 2010 | The complaint was received by DSD on 2 June 2010 regarding siren sound was generated from the site throughout the day which caused nuisance. | The noise source was generated from the alert system of the backhoe during operation. The backhoe was removed off site on 3 June 2010. | Closed |
| | Western Portal | 15 June 2010 | A public complaint was received by EPD hotline on 15th June 2010 complained about the construction works from Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site) affect their health of respiratory system | Based on the information collected, the air quality levels measured at AQ2 and AQ3 during the construction works were below the Action Level (321µg/m3 for 1 hour TSP and 156µg/m3 for 24 hour TSP). Also, the Contractor has implemented appropriate dust mitigation measures, such as providing water sprays on exposed surface, covering dusty materials and placing dust generation works in an area sheltered on the top and three sides etc on site to reduce dust impact to the residents arising from the construction works. | Closed |
| COM-2010-07-121 | Western Portal | 15 July 2010 | Cyberport Management Office lodged a complaint in | DNJV has delivered the reply letter to Cyberport Management Office on | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|---------------------|----------------|---------------|--|--|--------|
| | | | writing regarding the sands and mud left by the dump trucks on Cyberport road | <p>26 July 2010 stating the following:- The stain is not mud or debris. It is liquid of granite powder. Stain on the road was caused by heavy rainstorm which brings moisture to granite powder in trucks.</p> <p>The trucks have been equipped with tailor-made tanks to receive the liquid of granite powder. To prevent reoccurrence, DNJV will reinforce checking of these tanks and other truck conditions at work site to ensure no dripping before departure.</p> <p>In this regard, the Contractor was reminded that all vehicles and plant should be cleaned before leaving the construction site to ensure no earth, mud and debris or other wastes is deposited on roads. Proper maintenance of the tailor-made tanks equipped at the trucks is also needed to avoid any leakage.</p> | |
| COM-2010-07-123 (1) | Eastern Portal | 2 August 2010 | The complaint was received through the Project Hotline regarding the noise generated from construction vehicles. | Based on the information collected, the noise levels measured at NC1/NC1a and NC2 during the construction works were well below | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-------------------------|------------------|----------------|---|---|--------|
| COM-2010-07-123 (2) | | 2 August 2010 | The complaint was received by DSD concerning the noise generated from construction site at 19:00. | the construction noise limit or baseline level. The Contractor is also committed to implement sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents especially during the restricted hours. | |
| COM-2010-08-125 | | 3 August 2010 | The complaint was received by DSD concerning the noise generated from construction site until 8:00 pm every night. | | |
| COM-2010-08-124 | Intake TP789/TP4 | 2 August 2010 | The complaint was received by DSD regarding the construction works at Tregunter Path is extremely noisy and diminishes the ability of residents of the neighborhood to enjoy outdoor facilities | Based on the information gathered in the investigation, the noise levels at Tregunter Tower was within the construction noise limit of 75dB(A). The Contractor has taken initiative to minimize noise nuisance to the nearby residents by implementation of mitigation measures continuously as below: - Properly maintained and operated the construction plant (well-greased, damage and worn parts promptly replaced) - To install noise absorption blankets at the appropriate area to mitigate noise generated by the works. | Closed |
| COM-2010-08-124 (con'd) | | 5 August 2010 | The complaint was received by DSD regarding the construction works at Tregunter Path is extremely noisy and diminishes the ability of residents of the neighborhood to enjoy outdoor facilities | | |
| COM-2010-08-129 | | 12 August 2010 | The complaint was raised by the resident of Tregunter Path for the noisy works which | | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|---------------------|----------------|-----------------|--|---|--------|
| | | | was carried out after 18:00hrs at Intake TP4 | <ul style="list-style-type: none"> - To arrange the construction working period at Tregunter Path starting from 13th August 2010 as below: Monday – Friday: 08:00hrs to 18:00hrs Saturday: 08:30hrs to 18:00hrs Sunday and Public Holiday: No Works | |
| COM-2010-08-129 | | 12 August 2010 | The complaint was received from Protech Property Management Limited (the building manager of Tregunter Tower, 14 Tregunter Path, Mid-Levels, Hong Kong) regarding the noisy construction works at Tregunter Path | | |
| COM-2010-08-129 (2) | | 13 August 2010 | The complaint was received by RSS concerning the noisy work from the construction site on Saturday | | |
| COM-2010-10-151 | Eastern Portal | 15 October 2010 | A complaint was received from the resident of The Legend through the supervising officer on 15th October 2010 about the construction dust nuisance from Eastern Portal Site Area. | <p>Based on the information gathered in the investigation, no exceedance of air quality level was recorded at AQ1 since the commencement of the project works for Eastern Portal Site.</p> <p>The potential source of air quality impact arising from the removal of tunneling spoils from the tunnel portals as well as the vehicular emissions is minimized as all TBM excavation works have been completed since 5 October 2010.</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|-----------------|--|---|--------|
| COM-2010-10-154 | Eastern Portal | 18 October 2010 | <p>A complaint was received from the resident of Ronsdale Garden through the DSD on 18th October 2010 about the construction noise nuisance from Eastern Portal Site Area.</p> <p>According to the complainant, the noise seems to be generated by a pump.</p> | <p>Based on the information gathered in the investigation, the noise levels measured at The Legend (NC2) and outside True Light Middle School of Hong Kong (NC1) were well below the limit level.</p> <p>The Contractor agreed to terminate the operation of pump during the evening (1900 – 2300) and night (2300 – 0700) time since end of October 2010 and committed to implementing sufficient noise mitigation measures as recommended in the approved EIA report to minimize the nuisance caused to the nearby residents.</p> | Closed |
| COM-2010-10-155 | Intake RR1 | 11 October 2010 | <p>A letter from the Property Management of Peakville Court - Hong Yip Service Company Ltd was received by DNJV on 11th October 2010 about the construction noise nuisance and wastewater generated from Intake RR1 Site Area.</p> | <p>Based on the information gathered in the investigation, the noise levels measured at Peakville Court (NC13) and Ying Wa Girl's School (NC12) were below the baseline/limit level.</p> <p>In addition, water runoff was observed leaked out to the public road from the site area according to the regular site inspection.</p> <p>The Contractor will seal the bottom of barriers with concrete or provided</p> | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|--------------------|----------------|-----------------|---|---|--------|
| | | | | with sandbag as early as possible. | |
| COM-2010-11-160 | Intake TP789 | 5 November 2010 | The complaint was received from Kerry Property Management and advised that some complaints from the residents of Tavistock about low frequency noise generated by the power pack within Site Portion TP789. | Based on the information gathered in the investigation, the noise levels measured at near Intake TP789 were below the limit level after the Contractor implement noise mitigation measures for the noise generation activities. | Closed |
| COM-2010-11-160(2) | Intake TP789 | 9 November 2010 | Some residents complained the low frequency noise after the addition of sound proof sheets on the power pack at Intake TP789. | | |
| COM-2010-11-163 | Western Portal | 6 November 2010 | A complaint was received from a complainant regarding noise nuisance caused by spoils dropping directly from conveyor belt into barge (rock hitting sound) at Western Portal. | Based on the information gathered in the investigation, the noise levels measured at NC3 were below the limit level. | Closed |
| COM-2010-11-163(2) | Western Portal | 7 November 2010 | A complaint was received from a complainant regarding noise nuisance caused by spoils dropping from conveyor belt into storage basin (rock hitting sound). The complainant also | | |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|------------|-------------------------|--|--|--------|
| | | | complained the noise of ventilation fans at the Western Portal area. | | |
| COM-2010-11-164 | Intake TP5 | 10 November 2010 | Kerry Property Management Services received several complaints from the residents of Valverde on 10 November 2010 morning regarding working noise emitted from the Intake TP5 work site in early morning (before 7:30am). | Base on the information collected, the ad-hoc noise monitoring results measured at near Valverde was met the acceptable noise levels. Drill and blast is not considered with respect to noise annoyance, as the duration of blasting is very short and infrequent. | Closed |
| COM-2010-11-165 | Intake TP5 | 15 and 17 November 2010 | Kerry Property Management Ltd phoned DSD at about 17:08 hrs on 15 November 2010 relaying some complaints from the residents of Valverde about the noise/vibration due to the blasting works in past weeks. Jennifer also requested DNJV not to carry out blasting works at nights. | The Contractor volunteered to cancel late blasts and scheduling all blasts before 7pm as far as possible until the nearby adit blasting works completed by mid of December 2010 tentatively. | |
| COM-2010-12-170 | Intake DG1 | 7 December 2010 | The complaint was received regarding the noise arising from the excavation works, starting from 9:00 hrs, in the construction site near Evergreen Villa of Stubbs | Based on the information gathered in the Investigation, the noise levels measured at NC4 and NC6 in November and December 2010 were below the construction noise limit level or baseline levels. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|-------------|------------------|---|---|--------|
| | | | Road. | <p>The Contractor has taken initiative to erect noise absorption blankets at the site boundary to minimize noise nuisance to the nearby residents.</p> <p>The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases.</p> | |
| COM-2010-12-171 | Intake MB16 | 8 December 2010 | The complainant complained the works near Mount Butler Road generated dust, thus affecting the air quality in the vicinity. | DNJV would arrange water spraying at the entrance of Area B. In addition, Environmental Team and RSS would closely monitor to ensure relevant measures are effectively implemented. | Closed |
| COM-2010-12-173 | Intake W5 | 14 December 2010 | A complaint was received from a complainant regarding noisy construction activities at Site Portion W5 had affected her niece's study to prepare for examination. | DSD are now constructing an intake at the subject site under Hong Kong West Drainage Tunnel project. The construction work at Site Portion is expected for completion in end 2011. At the moment, the pipe piling works have been completed and the Contractor will carry out grouting work in this week and then excavation work afterwards. The noise generated by excavation works should be less than that of pipe piling | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|------------------|--|---|--------|
| | | | | works. Nevertheless, DSD would closely monitor the works in order to mitigate the noise impact to the nearby residents. | |
| COM-2010-12-178 | Intake TP5 | 22 December 2010 | Kerry Property Management Ltd notified that some complaints from the residents regarding the early commencement of the noise works at Intake Ste TP5 (earlier than 08:00hrs) in the past few days. | As advised by DNJV on 23 December 2010, they would carry out the work at site portion TP5 from 08:00 hrs to 19:00 hrs. Eddie Yau, DNJV Public Relation Manager had already explained to Kerry about the progress and arrangement at Site Portion TP5. | Closed |
| COM-2010-12-179 | Eastern Portal | 24 December 2010 | The Property Management Office of The Legend referred the complaint from the resident to DSD regarding the intermediate noise from Eastern Portal site portion in the morning and at night. | Based on the information gathered in the investigation, the noise levels measured at NC1 and NC2 were below the limit level. | Closed |
| COM-2011-01-181 | Eastern Portal | 21 January 2011 | The Property Management Office of Legend called DNJV to reflect a resident's concern on early construction noise at 8:30am on Saturday. | Based on the information gathered in the investigation, the noise levels measured at NC1 and NC2 were below the limit level. The breaking work to be completed by that day. | Closed |
| COM-2011-02-186 | Intake GL1 | 18 February 2011 | A complaint was received from the resident of Green Lane through the ICC on 18th February 2011 about the | Based on the information gathered in the investigation, the noise levels measured at near Green Lane was marginal below the construction | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|------------------|---|---|--------|
| | | | construction noise generated from the plant equipments being operated at Intake GL1 from early in the morning and ends at around 19:00 at night. | noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact. The major noise source due to the raise boring works has been finished since 26th February 2011 | |
| COM-2011-02-188 | Western Portal | 25 February 2011 | The complaint was received from the resident of Bel Air who called hotline at 3am and 4pm on 25 Feb 2011 to complaint about noise. The complainant refuses to give details on the noise. He claims that he will report this to the Police and requested DNJV to provide him with copy of CNP. | Based on the information gathered in the investigation, the noise levels measured at NC3 was below the limit level. | Closed |
| COM-2011-03-189 | Western Portal | 7 March 2011 | Property management office of Aigburth and Valverde transferred noise complaints of residents about the vibration and early working noise emitting from the TP5 and TP789. DNJV replied to explain to the PMO. | DNJV had already explained to Property management office of Aigburth and Valverde about the progress and arrangement at Site Portion TP5. The raise boring work to be completed by that day. | Closed |
| COM-2011-03-190 | Western Portal | 7 March 2011 | The complaint was received from the resident of Aegean | Based on the information gathered in the investigation, the noise levels | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|---------------------|----------------|---------------|--|--|--------|
| COM-2011-03-193 (1) | Western Portal | 14 March 2011 | Terrace who complained about the night-time noise of Western Portal. DNJV would review the works during the restricted hours and further improve the enclosure where necessary. | measured at Western Portal was below the construction noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact. | |
| COM-2011-03-193 (2) | Western Portal | 16 March 2011 | | | |
| COM-2011-03-192 | Intake B2 | 14 March 2011 | The PMO of Grand House at Macdonnell Road complained about the construction noise at the intake B2. In the site portion, rock excavation works was being carried out. The works was anticipated to complete in end April 2011. | Based on the information gathered in the investigation, the noise levels measured at near B2 was marginal below the construction noise limit. The Contractor has taken initiative to enclose the hydraulic breaker with noise absorption blankets to minimize noise nuisance to the nearby residents. The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases. | Closed |
| COM-2011-03-195 | Intake CR1 | 28 March 2011 | The complaint was received from the resident of Conduit Tower, who complained about the construction noise at the intake CR1. | Based on the information gathered in the investigation, the noise levels measured at near CR1 was well below the construction noise limit. The Contractor has taken initiative to erect noise absorption blankets at the whole site boundary to minimize noise nuisance to the nearby residents. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|------------|---------------|---|---|--------|
| | | | | The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases. | |
| COM-2011-05-210 | Intake GL1 | 30 May 2011 | The complaint was raised from the resident of Green Lane, who complained about the construction noise at the intake GL1. | Based on the information gathered in the investigation, the noise levels measured at near Green Lane was well below the construction noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact. | Closed |
| COM-2011-05-211 | Intake CR1 | 30 May 2011 | The complaint was received from the resident of Conduit Tower, who complained about the construction noise at the intake CR1. The complainant mainly concerned that the noisy works at Intake CR1 started at 8:00 hrs everyday is too early. He requested to defer the working hours later. | Based on the information gathered in the investigation, the noise levels measured at near CR1 was well below the construction noise limit. The Contractor has taken initiative to erect noise absorption blankets at the whole site boundary to minimize noise nuisance to the nearby residents. The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|---|--|--------|
| COM-2011-06-214 | Intake P5 | 2 June 2011 | The public complaint was raised on 2 nd June 2011 via Environmental Protection Department (EPD) regarding the construction noise nuisance from the Hong Kong West Drainage Tunnel construction site at Intake P5. | Based on the information gathered in the investigation, the noise levels measured at near P5 was well below the construction noise limit. In addition, the pipe-piling work has been stopped until the end of July 2011. However, the Contractor has prepared the remedial action that should be taken while starting the pipe-piling work. The Contractor was reminded to review the effectiveness of the implemented noise mitigation measures from time to time during different construction phases. | Closed |
| COM-2011-07-218 | Western Portal | 2 July 2011 | A public complaint was received from the resident of Aegean Terrace on 2nd July 2011 regarding the construction noise nuisance from the Hong Kong West Drainage Tunnel construction site at Cyberport (i.e. Western Portal Site) near Aegean Terrace. | Based on the information gathered in the investigation, the noise levels measured at Western Portal was below the construction noise limit. However, the Contractor has already implemented the noise mitigation measures to reduce noise impact. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|--------------|---------------|--|--|--------|
| COM-2011-07-219 | Intake P5 | 8 July 2011 | A public complaint was received from the resident of Belmont Court on 8th July 2011 and suspected in relation to the construction noise nuisance from the Hong Kong West Drainage Tunnel construction site at Intake P5. | Based on the information gathered in the investigation, the noise levels measured at near P5 was well below the construction noise limit. In addition, the pipe-piling work has been stopped until the end of July 2011. However, the Contractor has prepared the remedial action that should be taken while starting the pipe-piling work. | Closed |
| COM-2011-07-225 | Intake PFLR1 | 27 July 2011 | A resident, lives near Intake PFLR1, called DSD complaining the noise generated from the RBM. The noise probably generated from the RBM drilling rig. | Based on the information gathered in the investigation, the noise levels measured at near PFLR1 was below the construction noise limit. In addition, the Contractor has taken initiative to enclose or wrap the noise source with sound insulating materials to minimize noise nuisance to the nearby residents. | Closed |
| COM-2011-07-227 | Intake CR1 | 30 July 2011 | A resident complained about the noise from the Site Portion CR1. She said it was not supposed to work on Saturdays. | DNJV responded that the working hours are from Mondays to Saturdays. Currently, pipe piling works were in progress. They would improve the mitigation measure. According to the noise level measured at podium of Conduit Tower starting at 10:09 hrs on 1 August 2011, it was 73.5 dB(A). The works was completed at 9:10 hrs on 2 August 2011. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|---|--|--------|
| COM-2011-07-228 | Eastern Portal | 29 July 2011 | The complaint was lodged by a complainant who referred some residents' complaints about the dust and smoke generated from Eastern Portal tunneling works recently. He urged to implement an effective and protective mitigation measures as soon as possible. | Both the 1-hour and 24-hour TSP monitoring results in July 2011 showed dust levels at True Light Secondary School were under Action and Limit Levels. The potential sources of smoke or dust may be occasionally generated at the Eastern Portal as a result of the difference in atmospheric condition such as temperature and humidity inside and outside the tunnel. This is a normal atmospheric phenomenon and did not constitute to environmental impacts. There are sufficient measures to minimize the smoke or dust emission, such as sprinkle system inside adits under blasting works. There was no deficiency recorded in the Eastern Portal. Ventilation system inside the tunnel was designed to extract the blasting fume from adits towards the adit dust scrubber in the Western Portal and then discharged locally. There should not be blasting fume accumulated in the Eastern Portal with a normal ventilation system. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|----------------|--|---|--------|
| COM-2011-08-229 | W0 | 9 August 2011 | A resident complained about noise generated from DSD works area in the park on 24 Stubbs Road. The works caused obstruction to pedestrians and affected the environment. The complainant requested to obtain the contact of responsible person of the works. | Based on the information gathered in the investigation, the noise levels measured at the Hong Kong Academy was below the construction noise limit. According to the regular weekly site inspections in July and August 2011, there was no major noisy activity to be conducted at Intake W0. However, the Contractor has taken initiative to minimize noise nuisance to the nearby residents by implementation of mitigation measures before the time of complaint. | Closed |
| COM-2011-08-230 | EP | 11 August 2011 | A resident complained about the noise generated from rock breaking works at Eastern Portal during past few weeks. The complainant said that the noise was deafening and the breaking works was continuously carried out from 08:00 hrs to 18:00 hrs without consider the feeling of residents living nearby. It caused great nuisance to them. | Based on the information gathered in the investigation, the noise levels measured at the Legend was below the construction noise limit. However, the work was temporarily ceased after the complaint case emerged. To alleviate the breaking noise, the contractor plans to implement mitigation measures as far as practical. They may include wrapping the breaking head, erecting noise barriers or blankets, and controlling breaking duration. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|----------------|---|--|--------|
| COM-2011-08-232 | W10 | 24 August 2011 | A complainant said that noise came out from our Site Portion W10 near junction between Kotewall Road and University Drive, i.e. Intake W10 around 7:00 am on 19 August 2011 and requested us to keep the noise down in the early morning. | The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. All noisy activities, the start of machine including Raise Boring Machine or other supporting plants/equipments would only be started after 08:00hrs; 2. Only non-noisy activities i.e. site safety briefing, body stretching exercise etc. could be carried out within the Site Portion before 08:00hrs. | Closed |
| COM-2011-08-233 | P5 | 25 August 2011 | A resident complained that the noise generated from the Site Portion at the junction of Kotewall Road and Robinson Road caused immense nuisance. | Based on the information gathered in the investigation, the noise levels measured at the Legend was below the construction noise limit. The Contractor undertook some measures to alleviate the noise emission, as observed during site inspections. After receiving the complaint, the Contractor further reinforced the noise reduction measures that include extending noise barriers into a direction facing toward Villa Veneto, installing noise blankets at the piling rig curtain. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|----------------|---|--|--------|
| | | | | <p>In addition, the Contractor controlled the piling duration in order to minimize a continuous and persistent emission of piling noise.</p> <p>In early September, it was observed in site inspections that a large scale of building innovation work started in Villa Veneto. Continuous breaking noise from the innovation work imposed difficulties to justify noise sources and it may induce complaints from the general public.</p> | |
| COM-2011-08-234 | BR5 | 26 August 2011 | <p>The complainant is from the PMO of Camelot Height (金巒閣) on Kennedy Road (near Site Portion BR5). He said that construction noise, generated from the work site on the slope at the back of their building, was heard at about 07:30 hrs recently. It caused great nuisance to residents.</p> | <p>The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect:</p> <ol style="list-style-type: none"> 1. All noisy activities, the start of machine including Raise Boring Machine or other supporting plants/equipments would only be started after 08:00hrs; 2. Only non-noisy activities i.e. site safety briefing, body stretching exercise etc. could be carried out within the Site Portion before 08:00hrs. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|-------------------|--|--|--------|
| COM-2011-09-239 | MA14 | 28 September 2011 | A resident from PMO of Harbour View complained about the construction works of Site Portion MA14 near Magazine Gap Road started before 7:00hrs on 28 September 2011. The noise generated by the construction plants i.e. RBM was annoying. He requested to keep the noise down in the early morning. | The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. All noisy activities, the start of machine including Raise Boring Machine or other supporting plants/equipments would only be started after 08:00hrs; 2. Only non-noisy activities i.e. site safety briefing, body stretching exercise etc. could be carried out within the Site Portion before 08:00hrs. | Closed |
| COM-2011-10-240 | M3 | 23 October 2011 | A resident complained that the noisy drilling works were carried out at our Site Portion M3 near May Road on Sunday. At the time of the complaint, there are two workers of a subcontractor who entered into the M3 working area at about 2pm, without notifying the Contractor. The workers started excavating the bottom of the drop-shaft manually. | The Contractor is well aware of the related regulations about using powered mechanical plants in restricted hours. The Contractor was maintaining a close communication with all sub-contractors working in this Project. There was no previous case happened in other subcontractors and therefore it was believed that it was a discrete incident. The incident was attributed to the workers' ignorance of such regulations. The Contractor delivered an additional relevant training to | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|------------------|--|--|--------|
| | | | | brief the sub-contractor soon after the incident. It was re-iterated in the training that the subcontractor and his workers should strictly adhere to the related regulations, and they should obtain approval from the Contractor in advance to carry out works during restricted hours. | |
| COM-2011-11-242 | EP | 16 November 2011 | A resident complained about the noise at night around 9pm to 10pm in his premises at Ronsdale Garden. In addition, noisy construction has been carried out near Ronsdale Garden during the daytime recently. | <p>The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect:</p> <ol style="list-style-type: none"> 1. Rock breaking works due to the removal of temporary decking, structure and the river dam would be carried out intermittently. 2. RSS and the Contractor would regularly check the stream condition to prevent mosquito breeding, 3. The Contractor was reminded to expedite the works and implement noise mitigation measures as far as practicable. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|------------------|--|---|--------|
| COM-2011-11-243 | BR6 | 22 November 2011 | A resident at Ewan Court complained that a big noise, which should be generated by blasting works at intake BR6, was heard at about 13:49 at the day of complain. Some other residents heard similar “bang” noise last week at 6pm to 9pm. | The complainant was advised that two blasts per day were in progress at adit BR6. The Contractor will take the following follow-up measures: 1. Only one blast per day would be conducted starting on 28 November 2011 2. RSS would closely monitor the whole blasting process | Closed |
| COM-2011-11-244 | DG1 | 24 November 2011 | A resident at Villa Monte Rosa was annoyed by the noise generated from intake DG1 for couple of days. She asked when such noisy works would be completed. The resident added that more mosquitoes had been found recently and asked if the Contractor would take any measures against mosquito breeding. | The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. The breaker head was wrapped by noise absorptive materials 2. Sound proof sheet would be erected on the side facing Villa Monte Rosa 3. Mosquito oil would also be sprayed on the afternoon of 24 November 2011 | Closed |
| COM-2011-11-245 | TP5 | 24 November 2011 | A resident nearby would like to know the completion date of intakes on May Road. He complained about that such works started making noise at around 8:20am and questioned if such works got | The Contractor will take the following follow-up measures to alleviate the noise impacts from our site to the stakeholders in the vicinity with immediate effect: 1. Sound proof insulation sheet has been installed to remediate the | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|------------------|---|--|--------|
| | | | the permission to start as early as 8pm in the morning. | noise nuisance generated by the rock breaking works during the removal of the temporary structure 2. Noisy works would be carried out starting at 9am instead of 8am 3. RSS would closely monitor the site condition | |
| COM-2011-11-247 | HKU1 | 17 November 2011 | A professor at the University of Hong Kong complained about the percussive drilling noise generated from intake HKU1. The works started on 16 November at about 1pm. He requested to take steps to halt the severe noise. | Noise enclosure with Sound proof sheet was erected on 23 November 2011. | Closed |
| COM-2011-12-248 | EP | 1 December 2011 | A resident from Ronsdale Garden complained about the noise nuisance at Eastern Portal | The drill of the breaker was wrapped up by noise absorptive materials. Sound proof sheets were erected on 5 December 2011 to further mitigate the noise. Regular noise monitoring would be conducted. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|------------------|--|--|--------|
| COM-2011-12-249 | EP | 12 December 2011 | The complainant complained that water was found flowing onto carriageway and pedestrian from Eastern Portal. | The drainage system at EP has been cleaned up and cleaning frequency would be increased when necessary. All drivers were reminded to wash their vehicles' wheels within EP compound. | Closed |
| COM-2011-12-252 | EP | 17 December 2011 | The Project Management Office of The Legend referred a resident's complaint about noise generated from Eastern Portal at about 7am. | The complainant was advised on the same day at 11:30am that all noisy construction works would only be carried out after 8:30am from Monday to Saturday starting from 17 Dec 2011. | Closed |
| COM-2011-12-255 | EP | 21 December 2011 | The residents near Eastern Portal concerned about that the noise generated has recently become more severe, and the works started at around 8am which seems to be too early. | The noisy works will be carried out intermittently and would not be carried out before 8:30am. The Contractor is also studying the possibility of the use of chemical explosives instead mechanical breaking. | Closed |
| COM-2011-12-256 | EP | 29 December 2011 | A resident of The Legend complained about the noise generated from Eastern Portal starting from 28 Dec 2011, and enquired about the completion date of all noisy works. | The complainant was advised on the same day at 1pm that the noisiest works would be completed before Chinese New Year and all construction works were scheduled for completion in mid 2012. He was also assured that all noisy works would be carried out intermittently to mitigate the noise nuisance to the nearby residents. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|------------------|--|--|--------|
| COM-2012-01-257 | EP | 31 December 2011 | The complainant complained about the noise nuisance to the residents nearby at Eastern Portal. | The complainant was advised that the Contractor has already implemented noise mitigation measures such as wrapping the breaker head and erecting the sound proof sheets. The Contractor is also studying the possibility of the use of chemical explosives instead mechanical breaking. | Closed |
| COM-2012-01-258 | EP | 9 January 2012 | A resident near Eastern Portal complained about the noise generated from the site at about 8:15-8:20 am, and enquired when the construction works would be completed. | The complainant was assured that such work would not be carried out before 8:30 am and was told that the project would be completed mid-2012. She was also informed that the Contractor has erected sound proof sheets and been considering using alternative method to minimize noise. | Closed |
| COM-2012-01-263 | EP | 16 January 2012 | The resident heard a non-stop pumping sound on 14 January night at 2.15 am. Although he closed all doors and windows, he still heard the regular 'bump bump bump' humming sound. | The complainant was advised that the 'bump bump' sound might be generated by the water pump within the site portion. She was informed that the pump will be switched off between 7pm to 7am of the next day to minimize the noise nuisance. The situation would be monitored closely by both RSS and the Contractor. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|-----------------|--|--|--------|
| COM-2012-01-267 | EP | 27 January 2012 | A resident at the Legend complained about noise generated from Eastern Portal, which started from 7am until 5 or 6pm every day. The complainant also enquired about when the construction works would be completed. | She was assured that breaking works would not be started before 8am everyday and the Contractor would adopt the revised breaking method. | Closed |
| COM-2012-02-268 | EP | 3 February 2012 | The complainant complained about a “woo woo” noise at 11pm on 2 Feb night. He suspected that the noise was generated from the electric motor at Eastern Portal and requested the Contractor to switch it off at night. | The complainant was advised that no works were carried out at night on 2 Feb. Moreover the water pump and all construction plants had been switched off. He was assured that the Contractor would closely monitor the situation. | Closed |
| COM-2012-02-273 | PFLR1 | 6 February 2012 | The complainant complained about the noise generated from intake PFLR1 inside Pokfulam Playground. | The complainant could not be reached at phone on three trials from 6-8 Feb. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|------------------|---|--|--------|
| COM-2012-02-276 | W8 | 13 February 2012 | The complainant complained about the noise generated from construction works at intake W8 starting as early as 8am. He also enquired the completion date of works of the project. | The existing water pump has been installed with additional cover. The shaft opening has been covered by sound proof sheets. Additional noise panel was also constructed to screen the noise to be emitted to the neighbouring residential areas. | Closed |
| COM-2012-02-278 | W8 | 17 February 2012 | Residents at 80 Robinson Road complained about a continuous low frequency “woo woo” noise between 10pm to 4 am at midnight. Later, the “woo woo” sound was also heard on 18 Feb and on 20, 22 Feb during daytime. | On-site investigation was carried out by the Contractor and the RSS. Construction plants and activities were requested to stop to verify the noise. It was concluded that the noise was not generated from our construction site. | Closed |
| COM-2012-02-282 | BR6 | 27 February 2012 | Some members of Incorporated Owners of Ewan Court complained about a continuous noise (like from a running machine) from the construction site all over the night. | The complainant was advised that during night time, mainly adit lining works was performed and such work is scheduled to be completed in early May 2012. The opening of the dropshaft has also been covered by sound proof sheets to act as a noise barrier. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|---------------|--|--|--------|
| COM-2012-03-284 | W8 | 5 March 2012 | Residents at 80 Robinson Road complained about the mechanical noise nuisance in 24 hours from Intake W8. | Referring to the on-site investigations in February 2012, it was concluded that the continuous low frequency noise was not generated from our construction site. In addition, there was no heavy mechanical means in our construction site generating such noise. The complainants again agreed with the advice. | Closed |
| COM-2012-03-289 | M3 | 26 March 2012 | The complainant complained about the noise generated from the construction site on Saturday 24 March 2012. | The complainant was advised that the noise was generated by removal of concrete head wall at intake M3. To minimize noise nuisance, the Contractor has deferred to start the noisy work at 8:30 am every day. The removal works had been completed on 27 March 2012. | Closed |
| COM-2012-04-294 | MA17 | 13 April 2012 | The complainant complained about the noise generated from construction works at intake MA17 at 7 am. | The complainant was advised that works in progress at intake MA17 did not cause much noise. She was also assured that noisy works at intake MA17 would only be started after 8 am. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|--|---|--------|
| COM-2012-05-298 | Western Portal | 1 May 2012 | The complainant complained about the recent noise generated from Western Portal at midnight until 4am. | From investigation, Concreting works was carried out at night at Western Portal until 9pm but no construction works was carried out at Western Portal at midnight. | Closed |
| COM-2012-05-305 | Eastern Portal | 14 May 2012 | The DC member of Wan Chai has recently received complaints from residents near Eastern Portal about the noise generated from the site. | Upon receipt of the complaint, the noisy rock-splitting works was temporarily stopped. The Contractor has wrapped up the breaker and carried out the noisy works intermittently. | Closed |
| COM-2012-06-311 | Eastern Portal | 4 June 2012 | A resident of the Legend complained about the low frequency noise generated from Eastern Portal. She also felt the vibration in her flat whole night, which caused great nuisance. | The Contractor has relocated the generator, which is believed to be the source of noise. The complainant was contacted again and said the noise has stopped at 7pm of the same night. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|---|--|--------|
| COM-2012-06-312 | Eastern Portal | 4 June 2012 | The PMO of the Legend referred the complaints from their residents about the low frequency noise generated at Eastern Portal starting from 2 June 2012 at midnight. | The complainant was advised that all works were only carried out inside tunnel at night at the time of complaint. He was contacted again on 5 June 2012 and mentioned that no noise was heard on 4 June 2012 midnight. | Closed |
| COM-2012-06-313 | Western Portal | 2 June 2012 | A resident at Aegean Terrace complained about the noise nuisance at day time. | The complainant was advised that all the noisy construction activities within Western Portal will be completed in late June 2012. | Closed |
| COM-2012-06-316 | Eastern Portal | 18 June 2012 | The DC Member of Wan Chai District referred a resident from the Legend, who complained about the low frequency “wuung” engine noise generated from Eastern Portal throughout the day. | The complainant has been advised that the old generator has been replaced by a new one. The generator would only be switched on before 7:45am and after 7pm every day. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|---------------|--|---|--------|
| COM-2012-07-318 | Eastern Portal | 12 July 2012 | The Environmental Protection Department complained about the muddy water discharged to a nearby public drainage at Eastern Portal. | <p>The muddy water is identified as the cleaning of mud tracks at the site entrance of Eastern Portal.</p> <p>The Contractor has taken initiative to minimise the amount of water dripping due to wheel washing, including:</p> <ul style="list-style-type: none"> Inspecting the conditions of the truck wheels and determine the necessity on wheel washing; Inspecting the conditions of the truck wheels after their wheel washing such that water dripping from the wheels could be collected within the site boundary before allowing the truck to leave from Eastern Portal; and Using mops to absorb the mud tracks before washing the mud tracks by water on carriageway or footpath near Eastern Portal. | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------|----------------|---|---|--------|
| COM-2012-07-320 | RR1 | 20 July 2012 | The Property Management Office of the Peakville Court complained about noise generated from loading and unloading of construction materials at Intake RR1 in early July. | A meeting with the PMO was held on 5 July 2012 with the representative of DSD, ARUP and DNJV. It was explained that the loading and unloading works had been completed and agreed that no noise nuisance was heard. | Closed |
| COM-2012-08-328 | MB16 | 24 August 2012 | A resident near the Site Portion Intake MB16 complained about a “vee” sound, which may be generated by ventilation fans or motors. | Site investigations by the RSS with the PMO were conducted on 28-30 August 2012. The PMO called on 31 August 2012 to confirm that the noise was generated by their flushing system. | Closed |
| COM-2012-08-329 | MB16 | 25 August 2012 | The Property Management Office of Chun Fung Tai near Intake MB16 logged 3 complaints regarding the “vee” noise heard in early morning and mid night. The case is under investigation. | | Closed |

| Log Ref. | Location | Received Date | Details of Complaint | Investigation/Mitigation Action | Status |
|-----------------|----------------|------------------|--|--|--------|
| COM-2012-09-334 | Eastern Portal | 3 September 2012 | A Legislative Councilor referred a complaint from a resident residing on Tai Hang Road about the construction noise generated from Eastern Portal. | <p>Throughout the project, noise mitigation measures at Eastern Portal by the Contractor include:</p> <ul style="list-style-type: none"> (i) Installing noise enclosure; (ii) Minimizing amount of powered mechanical equipments operating at the same time; (iii) Avoiding noisy works at school examination period <p>After on-site review by the Contractor at Eastern Portal in early September 2012, major construction works from September 2012 onwards was found out to be reinstatement and E&M works, which are not considered to be noisy works. No other major noise nuisance was identified at Eastern Portal during the time of complaint.</p> <p>The Contractor will monitor the situation closely to minimize noise nuisance to nearby residents.</p> | Closed |