Ref: SHW-01 Construction Date: Unknown

Recorded on: 18.09.03 | Condition: Good

Updated on: Orientation: South

Type: Earth God Shrine | Map Ref: N/A | Historical Associations: None

Description: The platform of the shrine consists of three cut granite slabs with two cut granite slabs placed lengthwise on either side; cut stone incense holder and inscribed stone slab are placed at the rear of the platform and are surrounded by loose stones and a single uninscribed shaped stone.

Present Use: Shrine

Past uses: Shrine

Decorative features: Inscribed decoration on the front of the stone incense holder. 本X土地福德

福禄壽

Renovations: None

Setting: Shrine located to the east of the main village, set back from the existing road and to the southeast of the Pui O Pumping station.

Additional Notes: A Dang Fu shrine is locate to the east of the shrine



Ref: SHW-02 Construction Date: Unknown

Recorded on: 18.09.03 | Condition: Fair

Updated on: Orientation: Southeast

Type: Well and shrine Map Ref: N/A

Present Use: Well

Past uses: Well

Historical Associations: None

Description: Uncut stone and cement wall enclosure with shrine niche located southwest wall; niche constructed with concrete lintel slab, a stone is situated within the niche and a stone slab is positioned in front of it; well opening is surrounded by concrete sides and covered with a metal grill.

Decorative features: None

Renovations: Concrete covering

Setting: Located in the north-east of the Pui O Lo Wai Tsuen

Additional Notes: water channel cut in left side of the floor, draining under path.



Ref: SHW-03 Construction Date: c. 80 years

Recorded on: 18.09.03 | Condition: Poor

Updated on: Orientation: South

Type: House Map Ref: #33

Present Use: Residential

Past uses: Residential

Historical Associations: None

Description: Pitched roofs over front section and rear section. Roof is covered with 'tar paper' chunam stops are visible, most have concrete patching over them. Walls have render covering, southwest corner has cut stone slab with whitewash; double panel entrance door painted dark red; cut granite threshold stone; two windows are located in the east wall; foundation also covered with render. There is an annex room on the east side of the building, it has a slanting roof also covered in 'tar paper'. There is a window in the south wall.

Decorative features: Moulding under the eaves on the façade.

Renovations: Patching of roof

Setting: Near the front of the village in the central area.



Ref: SHW - 04 Construction Date: Unknown

Recorded on: 18.09.03 Condition: Ruin

Updated on: Orientation: North-east

Type: House Map Ref: #10 Historical Associations: None

Description: Two units, only remaining features are portions of pounded earth walls and some render remains, roofs have completely collapsed.

Present Use: Abandoned

Past uses: Residential

Decorative features: No decorative features.

Renovations: None

Setting: Located at a height of approximately 10 meters PD, at the southern end of Pui O Lo Wai



Ref: SHW-05 Construction Date: Unknown

Recorded on: 18.09.03 Condition: Fair

Updated on: Orientation: South

Type: Shrine Map Ref: N/A

Present Use: Shrine

Past uses: Shrine

Historical Associations: None

Description: Boulders make up the rear of the enclosure with two cut stone blocks forming the sides of the shrine; base consists of four cut granite slabs, bordered by granite slabs as well. Stone incense holder sitting on stone slabs; red brick, cement covered circular burner, located at right front. Dang Fu shrine at left side.

Decorative features: No decorative features.

Renovations: None

Setting: Shrine is located in the mid section of the village at the rear of a terrace level with a wooded hill slope directly behind it.



Location: Pui O Lo Wai village

Ref: SHW-06 Construction Date:

Recorded on: 18.09.03 Condition:

Updated on:

Orientation: South-southeast

Map Ref: #71

Type: Tsz Tong 裕德堂

(Yu Tak Tong)

Present Use: Tsz Tong

Past uses: Tsz Tong

Historical Associations: None

Description: Single pitched roof; chunam roll tiles and pan tiles over timber; two wooden panels under projecting eaves of façade; façade wall with piers at each end; render covered façade wall; side and rear walls are cut stone covered by render with irregular oval openings showing the stones. Entranceway has wooden jambs and lintel, concrete threshold; red painted double panel door; drains at rear and side

Decorative features: Inscription above the door. 裕德堂

Renovations: Modern render covering on walls.

Setting: Located to the north of the centre portion of the village.

Additional Notes: Interior floor is tile. Walls are unpainted and have no decorative features.



Ref: SHW-07 Construction Date: 1969

Recorded on: 18.09.03 | Condition: Modern

Updated on: Orientation: South

Type: Tsz Tong 何氏宗祠 Map Ref: Beside #65

判氏示何 (Ho's Ancestral Hall) Present Use: Tsz Tong

Past uses: Tsz Tong

Historical Associations: None

Description: Rectangular concrete building with metal framed windows and metal entrance door. Façade wall has piers on either end. Walls are painted white.

Decorative features: Parapet on faç ade with inscription 何氏宗祠 and '1969' date at top.

Renovations: Structure was rebuilt in 1969.

Setting: Located at the eastern end of the village.

Additional Notes: Style is similar to that of Tsz Tong (SHW-05 and 07).



Location: Lo Uk village

Ref: SHW-08

Construction Date: 1971

Recorded on: 18.09.03

Condition: modern

Updated on:

Orientation: south

Map Ref: Tsz Tong

Type: Tsz Tong 羅氏宗祠 (金茂堂)

Law's Ancestral Hall (Kam Mau Tong) Past uses: Tsz Tong

Present Use: Tsz Tong

Historical Associations:

Description: Rectangular concrete building. There are two brick piers with concrete bases on the façade, (the bricks are painted red). Metal framed windows and metal doors.

Decorative features: Parapet on facade with inscription and inscription above the entrance door.

Renovations: modern replacement structure.

Setting: The Tsz Tong is located at the east of the village.

Additional Notes: Style of Tsz Tong is similar to that of other Tsz Tongs in the village (SHW- 60 and 07)



Location: Lo Uk Tsuen

Ref: SHW-09 Construction Date: Modern

Recorded on: 18.09.03 Condition: Modern

Updated on: Orientation: South

Type: Shrine Map Ref: N/A

Present Use: Shrine

Past uses: Shrine

Historical Associations:

Description: Two shrines. (A) consists of concrete rectangular enclosure with pitched roof.; painted white with red characters along sides on the front; simple altar inside with wooden plaque.


(B) consists of horse-shoe shaped enclosure without top; stepped sides and curved at the rear part, painted white; triangular shaped stone set against rear wall. Modern incense holder. Dang fu shrine set along western side.

Decorative features: Red trim paint on enclosures. Inscription; 精忠昭日月 義勇壯山河

Renovations: Recently painted.

Setting: Behind the Tsz Tong and to the east.

Additional Notes: Associated with the Tsz Tong

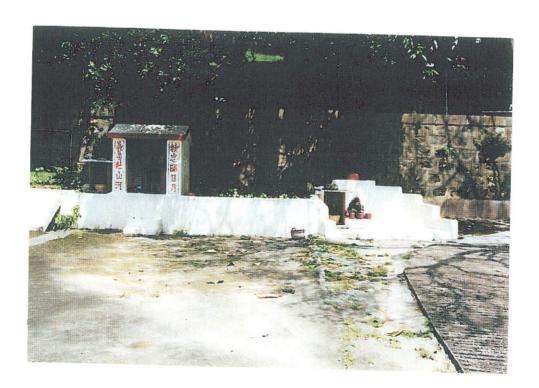

Ref: SHW-10

Recorded on: 15.10.03

Updated on:

Type: House (four units)

Construction Date: c. 100 years

Condition: Unit a: good Units b, c and d: ruin

Orientation: Southeast

Map Ref: Beside 49

Present Use: Unit attached to #49: is residential. other three units are

abandoned.

Past uses: Residential

Historical Associations: None

Description: The unit that is attached to # 49 has a pitched roof with roll tiles and shaped chunam stops. The rear section of the roof is covered in concrete. This unit has pounded earth walls with render cover. The tile roofs of these three units are partially collapsed and overgrown. The other three units also have pounded earth walls facades and rear walls. The northeastern side wall is cut stone and there is one window in this wall. There is also a small, uncovered opening on the left side of the door on the unit attached to #49. The rear wall has four windows. The doors of the units are either modern or missing.

Decorative features: None.

Renovations: Concrete patching on roof. Air-con unit at rear of unit attached to #49.

Setting: In the central front section of the village.



Ref: SHW -11 Construction Date: c. 100 years

Recorded on: 15.10.03 | Condition: Ruin

Updated on: Orientation: Southeast

Type: House Map Ref: N/A Historical Associations: None

Description: Roof has collapsed. Remaining walls consist of pounded earth with patches of render. The walls are heavily overgrown with vegetation. Doors have been removed. The interior has been filled with debris.

Present Use: Abandoned

Past uses: Residential

Decorative features: None.

Renovations: None.

Setting: In front section of the village near the front.



Ref: SHW - 12 Construction Date: C. 80 years Present Use: Abandoned

Recorded on: 15.10.03 | Condition: Poor

Updated on: Orientation: South

Type: House Map Ref: Beside # 72 Historical Associations: None

Description: Pitched tile roof with chunam stops. Heavily overgrown with vegetation. Cut stone walls covered by render in places. Wooden entrance door, modern concrete frame, threshold and steps. East wall has one window with wooden shutter, west wall has 2 small windows. Two windows on the façade.

Past uses: Residential

Decorative features: None.

Renovations: None.

Setting: central section of the village, lower terrace on the hill slope.



Ref: AAHB - 13 Construction Date: C. 80 years

Recorded on: 15.10.03 Condition: Fair

Updated on: Orientation: Southeast

Type: House (2 units) Map Ref: #31 Present Use: Residential and housing of

family shrine.

Past uses: Residential


Historical Associations: None

Description: Two storey rectangular structure. Pitched roof with roll tiles, concrete over the tiles. Plain roof ridge with finials. The façade and side walls are completely covered in render. The rear wall has cut granite blocks, which are partially covered by render. There are double panel wooden doors on both units. There is a concrete balcony on the first floor across the length of the façade. The southern most unit has an entrance door to the balcony intact, the other unit has a window which has been converted from a door, overlooking the balcony. The side walls have one ground floor and two first floor windows each. The rear wall has a small annex built out from it with a window in its southwest wall. There is also a window on the first floor of the main building.

Decorative features: There is a plain black frieze panel on the rear and both side walls with moulding above and below the panels. The concrete balusters of the balcony have cross and oval openings.

Renovations: Some concrete patching. Alterations of door to window.

Setting: Near the front of the village at the southeastern end.

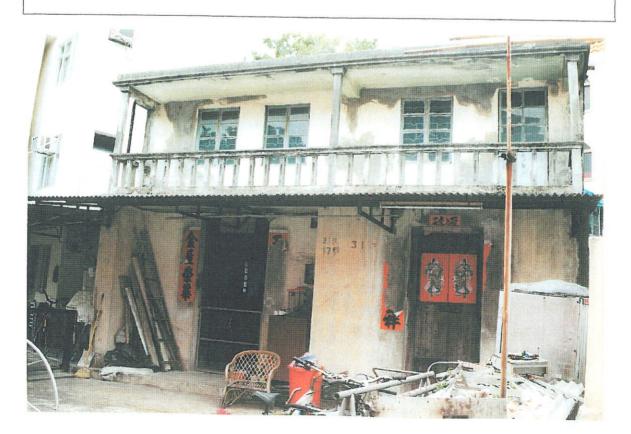

Ref: SHW - 14 Construction Date: Unknown

Recorded on: 15.10.03 | Condition: Good

Updated on: Orientation: North east

Type: Shrine Map Ref: N/A

Present Use: Shrine

Past uses: Shrine


Historical Associations: None

Description: Rectangular stone set into rear wall of concrete. Concrete platform in front of stone. There is a cut stone incense holder in front of the stone. There is a round sided concrete burner at the front of the platform.

Decorative features: None

Renovations: Concrete platform and rear wall.

Setting: The shrine is set into cut stone terrace walls.

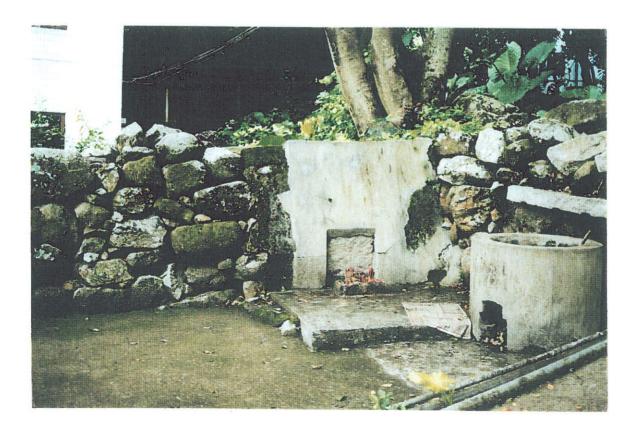

Ref: SHW-15 Construction Date: c. 100 years

Recorded on: 15.10.03 | Condition: Fair

Updated on: Orientation: South-east

TT TT

Type: House Map Ref: #108

Present Use: Family Shrine

Past uses: Residence

Historical Associations: None

Description: Rectangular shaped structure. Rear section of the house has a pitched roof (now collapsed) front part of the house has a flat roof with concrete balustrade with green urn style balusters. Walls are cut stone. Entrance door has been removed.

There is a small shrine made out of cut stone and concrete to the right of the entrance.

Decorative features: The corners of the concrete balustrade have panels with raised patterns (floral and geometric). The green ceramic balusters are set into concrete sections with moulded patterns.

Renovations: The front section has been sealed off from the rear section and the interior of front section has been completely covered in concrete, There is a family shrine located inside.

Setting: Near the back of the village.

Additional Notes: According to local informants the house belongs to a very wealthy family, who has moved away from the village.



Recorded on: 15,10,03

Updated on:

Ref: SHW - 16 Construction Date: Just prior to

WW II.

Condition: Fair

Orientation: South

Type: Shrine

Map Ref: N/A

Present Use: Shrine

Past uses: Shrine

Historical Associations: None

Description: Three pieces of red sandstone set into concrete in a rectangular shape form the rear wall of the shrine. There is a concrete incense holder in front of the stones set into a concrete platform.

Decorative features: None

Renovations: Concrete platform has been added at front of the enclosure.

Setting: Shrine is set at the front of a large boulder on the hill slope.

Additional Notes: There is a Dang Fu shrine in a wooden box at the front right hand side of the shrine.



Ref: SHW - 17 Construction Date: c. 70 years

Recorded on: 15.10.03 Condition: Ruin

Updated on: Orientation: Southeast

Type: Courtyard House | Map Ref: #87 & 88

(2 units)

Present Use: Abandoned

Past uses: Residential

Historical Associations: None

Description: Two rectangular units with only the front sections remaining. There is part of a flat roof remaining. The façade wall is made of cut granite blocks. The interior dividing wall is pounded earth with render. There is a balustrade running along the top of the façade wall. It has a concrete railing and supports with. Both units have concrete coating around the entrance ways and double panel wooden doors. Unit #87 has a cut granite threshold stone. The entire back section of the building has been demolished.

Decorative features: Moulding on the concrete balcony railing and green ceramic "urn" style balusters.

Renovations: Stone wall has been repointed.

Setting: In the north-eastern section of the village



Ref: SHW - 18 Construction Date: c. 70 years

Recorded on: 15.10.03 | Condition: Ruin

Updated on: Orientation: Southeast

Type: House (2 units) Map Ref: #89 & 90 Historical Associations: None

Description: Two rectangular units with only the front sections remaining. There is a partial flat roof remaining over this section. It is very overgrown with vegetation. The façade wall of #89 has been covered in concrete. The facade wall of #90 consists of four cut granite courses with smaller cut granite blocks above. The interior dividing wall consists of pounded earth covered in render (it is in very poor condition with the pounded earth fabric deteriorating and the plaster falling off in chunks. There are double panel wooden doors on both units and both have cut granite threshold stones. Unit #90 has a large granite lintel above an open space with iron bars, above the entrance door. The entire rear section of the building has been demolished.

Present Use: Abandoned

Past uses: Residential

Decorative features: None

Renovations: The concrete covering of the façade of unit #89 and the repointing of the façade of unit #90.

Setting: In the northeastern section of the village.



Ref: SHW - 19 Construction Date: Unknown

Recorded on: 15.10.03 | Condition: Fair

Updated on: Orientation: Southeast

Type: House Map Ref: #15 Histo

Past uses: Residential

Present Use: Abandoned

Historical Associations: None

Description: Single two storey abandoned unit with plain ridges tiled roof with chunam stops. Walls are covered in render. Modern entrance way with window above. Concrete eaves and concrete column added on the east. West front wall attached to stone wall covered in render and a window of a former building.

Decorative features: No decorative features

Renovations: Modern additions such as windows with concrete ledges.

Setting: Located at a height of approximately 10 meters PD, at the southern end of Pui O Lo Wai



Ref: SHW - 20

Recorded on: 15.10.03

Updated on:

Type: Terrace Row (3

Units)

Construction Date:

100yrs

Condition: Poor

Orientation: Southeast

Map Ref: #41, 42 and 43.

Present Use: Abandoned

Past uses: Residential

Historical Associations: None

Description: Three single story terraced units with plain roof ridge and roll tiles with shaped chunam stops. Ridge is collapsing as is the roof covering the most eastern unit. Pounded earth walls with render covering. Large cracks in the render have been patched with concrete. Double panel wooden door in all units with modern handles and locks. Window on either side of the door in the eastern unit and single wooden shuttered window to the east of the door of the western unit. The buildings are set on uncut stone platform, which has been covered in concrete. Concrete steps were added in front of each door from platform to ground level.

approx.

Decorative features: None.

Renovations: Electric utilities added

Setting: Located at a height of approximately 10 to 12 meters PD, at the southern end of Pui O Lo Wai

Additional Notes: Rear section added to the eastern unit



Ref: SHW -21

Construction Date: c. 60 years.

Recorded on: 15.10.03

Condition: Fair

Updated on:

Orientation: Southwest

Type: House (2 units)

Map Ref: #51

Present Use: Residential

Past uses: Residential

Historical Associations: None

Description: Semi-detached single story two units with roll tiled roof and shaped chunam stops. Plain roof ridge with finials. The walls consist of pounded earth with render. The entrance ways consist of modern metal doors. Single window with air conditioner in rear wall of western unit and single window in the side wall of the western unit.

Decorative features: Stepped moulding under eaves on the façade and the rear.

Renovations: Electric fixtures and modern doors.

Setting: Located at a height of approximately 14 meters PD, at the southern end of Pui O Lo Wai

Additional Notes: Concrete and boulder path leading up to the property.



Location: Pui O Lo Wai

Ref: SHW -22

Construction Date: Unknown

Recorded on: 15.10.03

Condition: Fair

Updated on:

Orientation: Southwest

Type: House

Map Ref: In front of # 54

Present Use: Abandoned

Past uses: Residential

Historical Associations: None

Description: Single storey freestanding unit, plain ridged roof with finials, roll tiles with shaped chunam stops. Walls covered with render. Large cracks in the render have been patched with concrete. Double panel wooden door. Small window on each side wall

Decorative features: Projecting tile eaves at the façade

Renovations: None.

Setting: Located at a height of approximately 12 meters PD, at the center of Pui O Lo Wai

Additional Notes: A boulder wall exists to the south of the building with a stream on the western side.



Ref: SHW -23 Construction Date: Unknown

Recorded on: 15.10.03 | Condition: Poor

Updated on: Orientation: Southwest

Type: Shed Map Ref: In front of #33 Historical Associations: None

Description: Single storey freestanding shed with metal corrugated roof and some tiles remaining at the edges of the roof. The walls consist of mud brick with render covering. No windows. Wooden entrance door.

Present Use: Storage

Past uses: Residential

Decorative features: None.

Renovations: None.

Setting: Located at a height of approximately 12 meters PD, at the center of Pui O Lo Wai

Additional Notes: Render is cracking and falling off in palces and mud bricks are decaying where exposed.



Ref: SHW -24 Construction Date: c. 1940

Recorded on: 15.10.03 | Condition: Good

Updated on: Orientation: Runs in roughly an

Type: Terrace Wall

Map Ref: N/A

Present Use: Terrace support

Past uses: Protective

Historical Associations: WW II

Description: Dry stone wall of uncut stones. Approximately 1.5 metres in height.

Decorative features: None.

Renovations: The wall has been patched with cement in places.

Setting: Along the hill slope in what is today the middle section of the village.

Additional Notes: According to local informants the wall was built just before the arrival of the Japanese. During that time, guns were provided to the villagers by the Government. The wall also served as a protection against thieves. Two village guards took duty at the boulder wall gate every night. During that period, all villagers lived behind the wall. After the War, villagers began to build houses in front of the wall.

