


ISO A1 594mm x 841mm
 Approved:
 Checked:
 Designer:
 Project Management Initials:
 20180224
 PATH: P:\PROJECTS\6056907\DRAWING\REPORT\AREA1_752.dgn

ID	DESCRIPTION	REMARKS
1	SKYPIER	EXISTING
2	SKYCITY MARRIOTT HOTEL	EXISTING
3	PASSENGER CLEARANCE BUILDING OF HKBCF	PLANNED
4	EAST SEA RESCUE BERTH - AIRPORT FIRE CONTINGENT	EXISTING
5	ASIAWORLD-EXPO	EXISTING
6	INTERMODAL TRANSFER TERMINAL	PLANNED

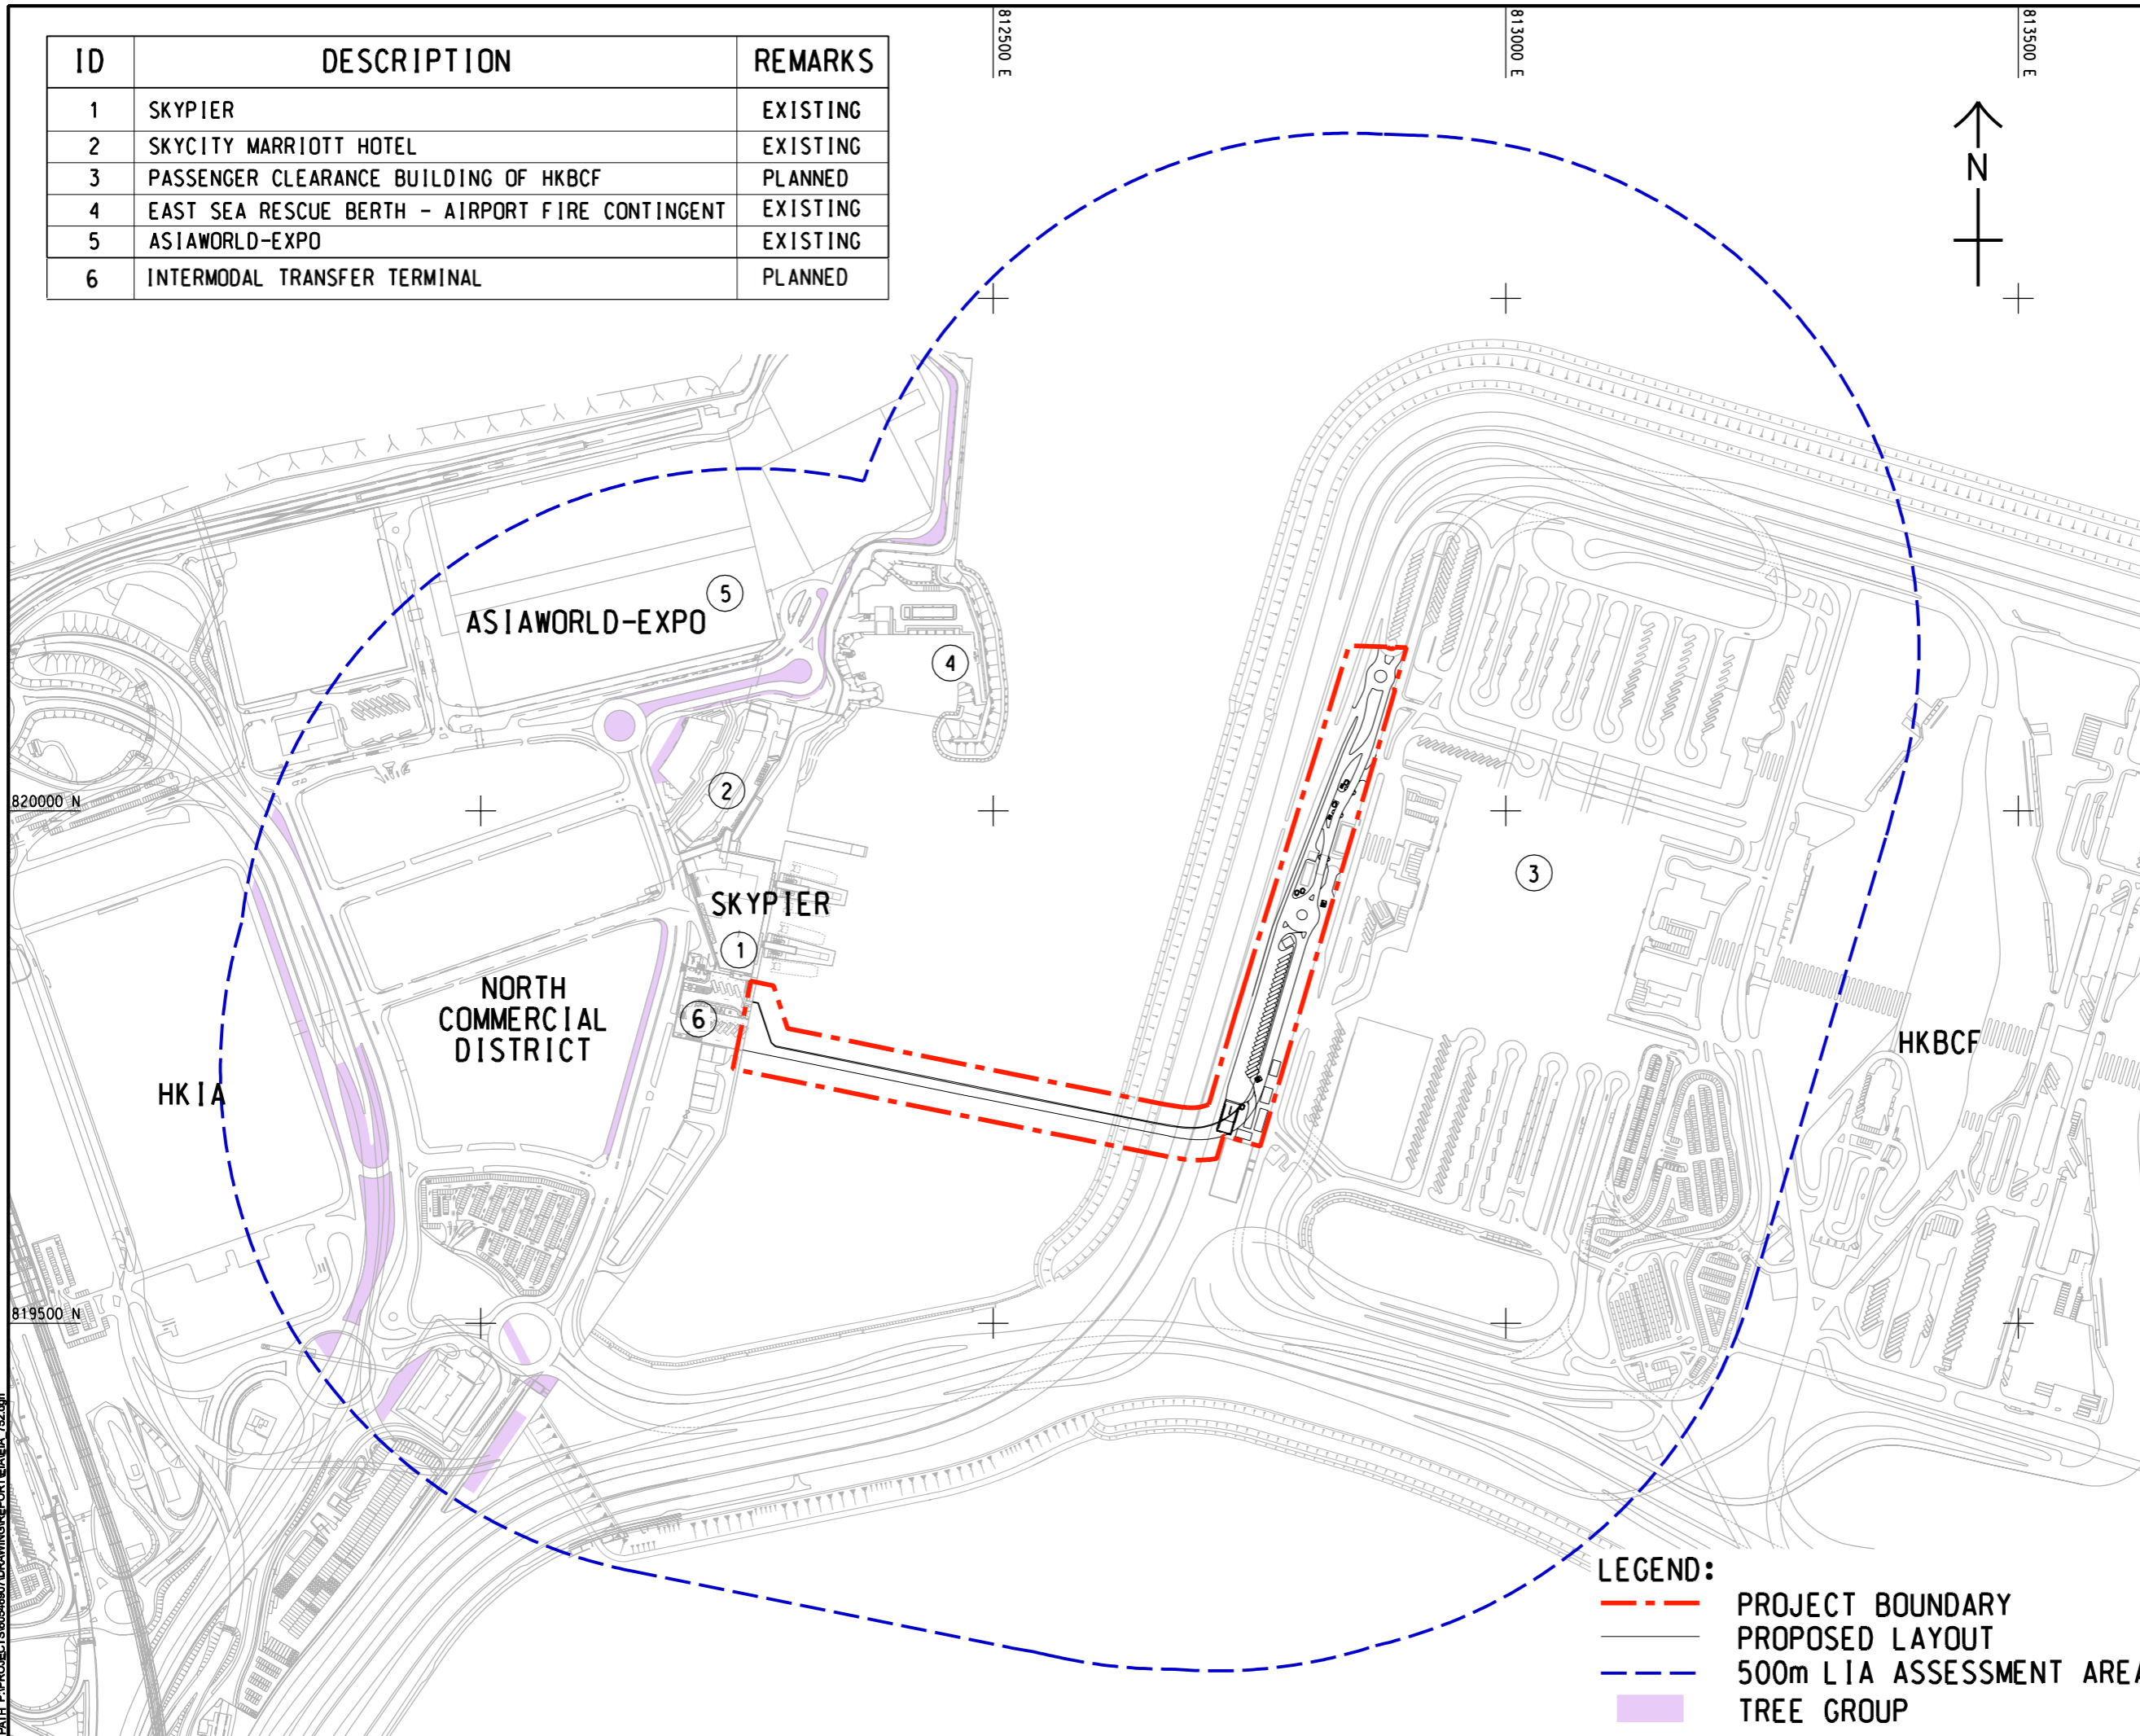

LEGEND:

- - - PROJECT BOUNDARY
- - - PROPOSED LAYOUT
- - - 500m LIA ASSESSMENT AREA
- TREE GROUP



PROJECT
 項目
INTERMODAL TRANSFER TERMINAL - BONDED VEHICULAR BRIDGE AND ASSOCIATED ROADS

CLIENT
 業主

 香港 | AIRPORT AUTHORITY HONG KONG
 機場管理局

CONSULTANT
 顧問公司
 AECOM Asia Company Ltd.
 www.aecom.com

SUB-CONSULTANTS
 分門工程師公司

ISSUE/REVISION
 修訂


NO.	DATE	DESCRIPTION	CHK.

STATUS
 狀態

SCALE
 比例
 A3 1 : 8000

DIMENSION UNIT
 尺寸單位
 METRES

KEY PLAN
 索引圖
 A3 1 : 20000

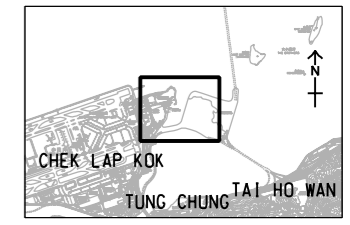

PROJECT NO.
 項目編號
 60546907

AGREEMENT NO.
 協議編號
 C17C03

SHEET TITLE
 圖名
 BROAD BRUSH TREE SURVEY PLAN

SHEET NUMBER
 圖號
 FIGURE A

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and disclaims any liability whatsoever, for any party that uses or relies on this drawing without AECOM's express written consent. Do not scale this document. All measurements must be obtained from the related dimensions.

Drawing No.	Species		Tree Measurements			Approx. Quantity of the group	Amenity Value	Form	Health Condition	Structural Condition	Suitability for Transplanting*		Conservation Status	Recommendation (Retain/ Affected)			Department to provide expert advice to LandsD	Justification	Additional Remarks
	Scientific name	Chinese Name	Height (m)	DBH (m)	Crown Spread (m)						(High/Medium/Low)	Remarks		%	Retain	Affected			
Figure A	<i>Chrysalidocarpus lutescens</i>	散尾葵	3	0.095-0.1	2	100	Fair	Fair	Fair	Fair	Medium	NIL	NIL	100% Retain	435	0	DLO	NIL	NIL
Figure A	<i>Leucaena leucocephala</i>	銀合歡	4-6	0.1-0.15	3-4	5	Fair	Poor	Fair	Fair	Low	f,g	NIL				DLO	NIL	NIL
Figure A	<i>Juniperus chinensis</i>	龍柏	3	0.095-0.1	2	20	Fair	Fair	Fair	Fair	Medium	NIL	NIL				DLO	NIL	NIL
Figure A	<i>Hibiscus tiliaceus</i>	黃槿	3-5	0.1-0.2	3-4	52	Fair	Fair	Fair	Fair	Low	b,c	NIL				DLO	NIL	NIL
Figure A	<i>Ravenala madagascariensis</i>	旅人蕉	5-6	0.2-0.25	4-5	50	Fair	Fair	Fair	Fair	Medium	NIL	NIL				DLO	NIL	NIL
Figure A	<i>Cocos nucifera</i>	椰子	9-10	0.25-0.3	2-3	44	Fair	Fair	Fair	Fair	Medium	NIL	NIL				DLO	NIL	NIL
Figure A	<i>Delonix regia</i>	鳳凰木	6	0.15	5	2	Fair	Fair	Fair	Fair	Low	b,c	NIL				DLO	NIL	NIL
Figure A	<i>Ficus microcarpa</i>	細葉榕	10	0.4	10	2	Fair	Fair	Fair	Fair	Low	b,c,d	NIL				DLO	NIL	NIL
Figure A	<i>Acacia auriculiformis</i>	耳果相思	7-8	0.1-0.2	5-6	35	Fair	Fair	Fair	Fair	Low	b,c	NIL				DLO	NIL	NIL
Figure A	<i>Acacia confusa</i>	台灣相思	7-8	0.1-0.2	5-6	35	Fair	Fair	Fair	Fair	Low	b,c	NIL				DLO	NIL	NIL
Figure A	<i>Cassia siamea</i>	鐵刀木	7-8	0.1-0.15	4-5	20	Fair	Fair	Fair	Fair	Low	b,c	NIL				DLO	NIL	NIL
Figure A	<i>Ficus benjamina</i>	垂葉榕	7-8	0.15-0.25	5-6	50	Fair	Fair	Fair	Fair	Low	b,c	NIL				DLO	NIL	NIL
Figure A	<i>Grevillea robusta</i>	銀樺	6-7	0.1-0.15	3-4	20	Fair	Fair	Fair	Fair	Low	b,c	NIL	DLO	NIL	NIL			

*No existing trees identified on Figure A are proposed to transplant

Remarks for Suitability for Transplanting

- (a) Low amenity value;
- (b) irrecoverable form after transplanting (e.g. if substantial crown and root pruning are necessary to facilitate the transplanting);
- (c) Low survival rate after transplanting;
- (d) very large size (unless the feasibility to transplant has been considered financially reasonable and technically feasible during
- (e) with evidence of over-maturity and onset of senescence;
- (f) with poor health, structure or form (e.g. imbalanced form, leaning, with major cavity/cracks/splits); or cavity/cracks/splits);
- (g) undesirable species (e.g. *Leucaena leucocephala* which is an invasive exotic tree).
- (h) On steep slope