
Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link

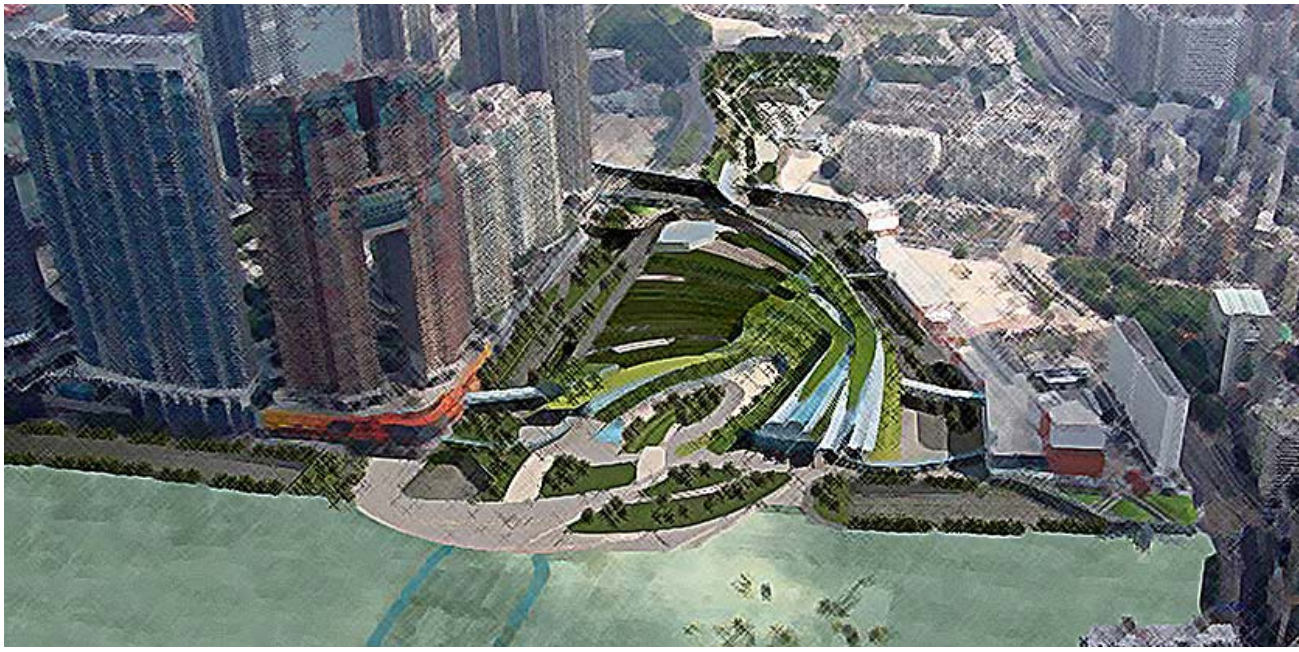

Environmental Monitoring and Audit Report

July 2011

MTR Corporation Limited

HONG KONG SECTION OF GUANGZHOU – SHENZHEN – HONG KONG EXPRESS RAIL LINK

(No. EP-349/2009/B)

Environmental Monitoring and Audit Report No. 17

(July 2011)

Verified by: _____

Position: Independent Environmental Checker

Date: 11/8/11

MTR Corporation Limited

HONG KONG SECTION OF GUANGZHOU - SHENZHEN - HONG KONG EXPRESS RAIL LINK

(No. EP-349/2009/B)

Environmental Monitoring and Audit Report No. 17

(July 2011)

Certified by: _____

Position: for Environmental Team Leader

Date: - 9 AUG 2011

EXECUTIVE SUMMARY

This is the 17th monthly Environmental Monitoring and Audit (EM&A) Report presenting the EM&A works undertaken during the period from 1 to 31 July 2011 for the Hong Kong Section of Guangzhou - Shenzhen - Hong Kong Express Rail Link (hereinafter referred to "the XRL" or "the Project") in accordance with the EM&A Manual and the requirement under EP-349/2009/B.

Air Quality

Air quality monitoring was conducted for 24-hour Total Suspended Particulates (TSP) at 17 air quality monitoring locations in the vicinity of Works Area in Mai Po (Works Area A) Ngau Tam Mei (Works Area B), Tai Kong Po (Works Area C), Shek Kong (Works Area D), Tse Uk Tsuen, (Works Area E), Pat Heung (Works Area F), Shing Mun (Works Area G), Shek Yam (Works Area H), Kwai Chung (Works Area J), Mei Foo (Works Area L), Nam Cheong (Works Area P, Q and R) and West Kowloon (Works Area V1 and V2) in the reporting month.

Please refer to the section "Environmental Complaints/Exceedance/Non-compliance/ Summons and Prosecution" below for the exceedance in air quality in the reporting month.

Airborne Noise

Airborne noise was measured in terms of $L_{eq(30min)}$dB(A) with L_{10} and L_{90} measurements as reference at 33 noise monitoring locations in the vicinity of Works Area in Mai Po (Works Area A), Ngau Tam Mei (Works Area B), Tai Kong Po (Works Area C), Shek Kong (Works Area D), Tse Uk Tsuen, (Works Area E), Pat Heung (Works Area F), Shing Mun (Works Area G), Shek Yam (Works Area H), Kwai Chung, (Works Area J and K), Mei Foo (Works Area L), Nam Cheong (Works Area M, N, O, P, Q, R, S and T) and West Kowloon (Works Area V1 and V2) once every week.

Please refer to the section "Environmental Complaints/Exceedance/Non-compliance/ Summons and Prosecution" below for the noise exceedance in the reporting month.

Monitoring of Avifaunal Species

Monthly ecological monitoring was conducted during the construction of Mai Po Ventilation Building Works Area (MPV), access road to Tai Kong Po Works Area (TPP-1/2/3), Shek Kong Stabling Sidings (SSS-2a/3), Pat Heung Ventilation Building Works Area (PHV-1) and Tse Uk Tsuen (TUW-1/2). The monitoring results indicated the survey areas were generally utilized by waterbirds in the reporting month during the monitoring. Decrease in avifauna abundance compared with baseline record was observed at TPP-1 survey area. Investigation was being carried out and the result of which would be included in the report in coming months. The situation would be closely monitored by ET and IEC.

Monitoring of Impact at Fishpond due to Noise

In accordance with the Monitoring and Emergency Response Plan, impact noise monitoring was conducted at fish pond on weekly basis for assessment of impact at fishponds due to noise. It was revealed from the monitoring results that all monitoring results were within the Limit Level. Based on the monitoring results, there was no adverse impact at fishpond due to noise.

Landscape and Visual

Regular inspections and audits conducted by certified Arborist found that the tree protection works being carried out by the civil works and transplanting contractors were in accordance with the requirements of EP and EIA.

Environmental Audits

In this reporting month, regular site inspections attended by representative from MTRCL and Contractors were carried out at 803A, 803B, 803D, 810B, 811A and 811B in West Kowloon, 802, 805 and 820 in Nam Cheong, 821 in Kwai Chung, 822 in Pat Heung, Shing Mun, Shek Yam, Tai Shu Ha Road West Magazine Site, So Kwun Wat Nursery and Magazine Site and Tsing Chau Tsai Barging Point, 823A and 823B in Shek Kong, Tse Uk Tsuen, To Kau Wan stockpiling facility and Rambler Channel Barging Point, 824 in Ngau Tam Mei and Tai Kong Po and 825 in Mai Po. In addition to the regular site inspections, IEC environmental audits attended by IEC, MTRCL and Contractors were held on monthly basis. Issues observed during these audits are detailed in Section 6.

Environmental Complaints / Exceedance / Non-compliance / Summons and Prosecution

For the reporting month, a total of 3 environmental complaints were referred from EPD. The environmental complaint received was related to construction noise from Shek Yam Tunnel; construction noise from grouting works in Hoi Wang Road and dark smoke and malodour at the works area near the Waterfront. Complaint investigations were conducted in accordance with the complaint handling procedure in the EM&A Manual. Details of complaints are contained in Section 7.

For the reporting month, noise exceedances of air-borne noise Limit Level were recorded at Wang Toi Shan (CN 8), No. 305B - Sheung Tsuen San Tsuen Village House (CN 15), HKIVE Haking Wong Waterfront Annex (CN 23), Sorrento (CN 31), The Waterfront (CN 32) and The Arch (CN 33). There was one noise exceedance of Action Level triggered due to complaint during daytime hours in the reporting month.

No exceedances of 24-hour TSP Action Level were recorded in the reporting month. In addition, no exceedance of 24-hour TSP Limit Level was recorded.

During the reporting month, a non-compliance was issued to the Contractor 824 for the discharge of muddy water at Tai Kong Po Works Area. The non-compliance incident was rectified by the Contractor immediately with mitigation measure provided. Please refer to Section 7 for details.

Works for Coming Month

Construction works were started in Works Areas A, B, C, D, D1, E, F, G, H, J, L, M, N, O, P, Q, R, S, V1, V2, W, Y, Z, AA, AC, AE and AG.

Please refer to Table 8-1 for the major works in the respective works areas. Impact monitoring would be continued in coming reporting month accordingly with reference to the EM&A Manual.

Further Environmental Key Issues

Air quality, airborne noise at NSRs and fishpond, ecological, landscape and visual monitoring shall continue in the following month. Considering the nature of

construction activities, key environmental issues in the coming months include the followings:

- Disposal of C&D waste;
- Dust generation from site activities;
- Noise impact from operating equipment;
- Site water discharge;
- Chemical wastes;
- Ecological impact;
- Trees protection

Reporting Changes

In the reporting period, there was no reporting change.

Table of Contents

EXECUTIVE SUMMARY 1
1. INTRODUCTION 6
2. PROJECT INFORMATION 7
3. ENVIRONMENTAL STATUS 11
4. SUMMARY OF EM&A REQUIREMENT 17
5. MONITORING RESULT 31
6. SITE INSPECTION 56
7. NON-COMPLIANCE AND DEFICIENCY 63
8. FUTURE KEY ISSUES 66
9. CONCLUSIONS 70

Appendix

Appendix A Works Area

Appendix B Project Management Organization and Contacts of Key Personnel

Appendix C Implementation Status

Appendix D Monitoring Locations

Appendix E Monitoring Schedule

Appendix F Graphical Plots of Monitoring Results

Appendix G Bird Species and Abundance Recorded during Avifauna Survey

Appendix H Representative Photographs of the Avifauna Monitoring

Appendix I Certified Arborist Inspection Record

Appendix J Vibration Monitoring Record at Cheung Yuen (LET-06)

Appendix K IEC Audit Findings on Pat Heung Ventilation Building Works Area

1. INTRODUCTION

1.1 Project Background

Further to the Government's decision made in April 2008, MTR Corporation (MTR) commenced to plan and design the Hong Kong Section of Guangzhou - Shenzhen - Hong Kong Express Rail Link (hereinafter referred to "the XRL" or "the Project"), which is a committed cross boundary transport infrastructure project.

The XRL would provide high speed rail services between Hong Kong and Guangzhou, and a connection to the national high-speed passenger rail network serving major mainland cities outside of Guangdong province. The Hong Kong section of the XRL is about 26km from new terminus located in West Kowloon (i.e. West Kowloon Terminus (WKT)) to the boundary at Huang gang. Along the railway corridor, there would be a total of eight ventilation buildings/ emergency access point (EAP), stabling sidings and a maintenance facility at Shek Kong Stabling Sidings (SSS) and an Emergency Rescue Station (ERS) next to SSS serving the operation of the XRL.

1.2 Coverage

This is the 17th monthly Environmental Monitoring and Audit (EM&A) Report presenting the EM&A works undertaken during the period from 1 to 31 July 2011 for XRL in accordance with the EM&A Manual and the requirement under Environmental Permit No. EP-349/2009/B.

2. PROJECT INFORMATION

2.1 Project Management Organisation and Management Structure

The project management organisation chart and contact of key personnel are shown in Appendix B.

2.2 Construction Activities

This report marked the 17th month of civil construction in Works Area A, B, C, D, D1, E, F, G, H, J, L, M, N, O, P, Q, R, S, V1, V2, W, Y, Z, AA, AC, AE and AG for July 2011. It is anticipated that the civil construction be completed in year 2015. The updated construction activity for upcoming month is provided in Section 8. Major construction activities undertaken in the reporting month is summarized in the following table.

Contract	**Works Area**	**Major Construction Activities**
Nam Cheong		
802	Q	Sheet-pilling, pre-drilling work, bored pile removal, H-pile extraction, pile cap demolition, excavation & lateral supports and utility diversion
805	N,O	Piers removal of footbridge, sheet piling works and pile removal
805	S	Demolition of pile cap and sheet piling work
West Kowloon		
803A	V1	Diaphragm wall remedial works, concrete coring and pumping test
803B	V1	Socketed H-piling works, Interface coring for bored piles, Bored Piling works and Slab demolition for box culvert

Contract	**Works Area**	**Major Construction Activities**
803D	V1	Loading test, remedial works and concrete coring
810B	V1	Bore piling, Pre-drilling, Excavation, Foundation work and Construction of temporary traffic deck
810B	W	Installing Conveyor System of Barging Facilities
811A	V2	Toe grouting, concreting works, pumping test, external works to CLP Sub Station at Lai Cheung Road
811B	V2	Construction for diaphragm wall, bored piling and H-piles, construction of temporary footbridge; culvert diversion
820	V2	Ground treatment
Nam Cheong		
811B	Y	Operation of Nam Cheong Barging Point
820	M	Preparation work for mini-piles of underpinning of Lai Chi Kok flyover, Sheetpiling for new pile cap construction completed, excavation and construction of pile cap, Driving of sheet pile for DS1 and SS1
820	P	Pile Removal Work, water main diversion, diversion of the 450 salt water main, Removal of H-pile RM1, Modification of working platform
820	R	Pile-removal; utilities diversion
820	S	Utilities diversion.
820	Y	Barging point site setup
821	Y	Rock unloading by trucks to the barge/ for stockpile, barging activity

Contract	Works Area	Major Construction Activities
Mei Foo		
820	L	Nil
Kwai Chung		
821	J	Establishment of workshop area, blasting, breaking and drilling work inside the portal of the tunnel, stockpiling, transportation of excavated materials to Barging Point
Pat Heung		
822	F	Construction inside tunnel adit Open-cut construction method had been adopted where adverse ground condition (soft ground) was encountered. The associated supporting works being carried out to maintain a safe working environment where adverse ground condition (soft ground) is encountered.
Shek Yam		
822	H	Main tunnel construction, installation of conveyor
Shing Mun		
822	G	Pipe piling
So Kwun Wat		
822	AC	Nil
Tai Shu Ha Road West Magazine Site		
822	AE	Nil
Tsing Chau Tsai Barging Point		
822	AG	Nil

Contract	**Works Area**	**Major Construction Activities**
Shek Kong Stabling Sidings		
823A& 823B	D and D1	Site formation, pre-drilling works, establishment of site office and stockpiling area, establishment of East and West Culvert
Tse Uk Tsuen		
823A	E	Guidewall construction
Rambler Channel Barging Point		
823B	Z	Establishment of wheel washing facilities
Ngau Tam Mei		
824	B	Bored piling works, retaining wall formation works, drainage works
Tai Kong Po		
824	C	Pipe piling works and grouting at Tai Kong Po Works Area
Mai Po		
825	A	Crane and TBM assembly
Siu Lam Barging Point		
825	AA	Nil
To Kau Wan Works Area		
823B	-	Nil

Table 2-1 Major construction activities in July 2011

3. ENVIRONMENTAL STATUS

3.1 Status of Implementation of mitigation measures

Environmental mitigation measures recommended in the EIA report were implemented and their implementation status are summarized in Appendix C.

3.2 Status of Submissions under EP

A summary of the submissions submitted under the EP for this Project during the reporting month is presented in Table 3-1 below:

EP-349/2009/B Clause No.	**Document Title**
2.11	Contingency Plan for Groundwater Drawdown for Contract 811B (Revision C)
2.11	Contingency Plan for Groundwater Drawdown for Contract 810B
2.21	Revised Contamination Assessment Plans for Mai Po Ventilation Building Works Area (Site C1 and D) (Rev C)
2.38	Further Archaeological Investigation Report - Shek Kong Stabling Sidings
2.46	Monthly EM&A Report

Table 3-1 Summary of the status of submissions submitted under the EP in the reporting month

3.3 Status of Permit/License/Notifications

A summary of the status of permits, licences and notifications on environmental protection made, applied or approved under this Project during the previous and reporting month is presented in Table 3-2 below. The Environmental Permit No. EP-349/2009/B issued by EPD was used for the XRL project.

Item	Item Description	Application Date	Permit Status
Contract 802 (Works Area Q)			
No updates in the reporting month			
Contract 803A (Works Area V1)			
No updates in the reporting month			
Contract 803B (Works Area V1)			
No updates in the reporting month			
Contract 803D (Works Area V1)			
1	Construction Noise Permit - Renewal	8 Jul 2011	Approved on 19 Jul 2011 (Permit No. GW-RE0522-11 valid till 31 Dec 2011)
Contract 805 (Works Area S, N, O)			
No updates in the reporting month			
Contract 810B (Works Area V1)			
No updates in the reporting month			
Contract 810B (Works Area W)			
1	Dumping Permit for Type 2 marine sediment	8 Jun 2011	Granted on 25 Jun 2011 Permit No. EP/MD/12-035, valid from 28/6/2011 to 27/07/2011
Contract 811A (Works Area V2)			

Item	Item Description	Application Date	Permit Status
1	Construction Noise Permit NP for grouting of D-wall and improvement of asphalt surface	13 Jun 2011	Permit no. GW_RE0477_11 Date of EPD approval 29 Jun 2011 valid till 15 Aug 2011
2	Construction Noise Permit For D Wall- Dewatering	11 Jul2011	Permit no. GW_RE0531_11 Date of EPD approval 31 July 2011 valid till 31 Dec 2011
Contract 811B (Works Area V2 & Y)			
1	Construction Noise Permit (For erection of temp. steel bridge at eastern portion)	18 May 2011	Licence No.: GW-RE0396-11 Valid from 8 Jun 11 to 7 Dec 11
Contract 820 (Works Area L, M, P, R, S, Y, T, V)			
1	Construction Noise Permit (Construction work at Lai Chi Kok Interchange)	13 Jun 2011	Permit GW-RW0435-11 obtained. Valid until 26 Nov 2011.
2	Construction Noise Permit (Construction work at Hing Wah Street West J/O Sham Mong Road.)	24 Jun 2011	Permit GW-RW0418-11 obtained. Valid until 30 Jun 2011.
3	Marine Dumping Permit (Type 2) at Launching Shaft, Hing Wah Street J/O Sham Mong Street,	28 Jun 2011	Permit EP/MD/12-038 at Launching Shaft was granted on 14 Jul 2011 and valid from

Item	Item Description	Application Date	Permit Status
	KLN		15 Jul to 14 Aug 2011.
Contract 821 (Works Area J, Y)			
1	Construction Noise Permit (24 hour Construction Work at Tai Lin Pai Road J/O Wing Yip Street, Kwai Chung, N.T.)	13 Jun 2011	Permit GW-RW0431-11 obtained. Valid until 12 Dec 2011.
Contract 822 (Works Area F, G, H, AC, AE and AG)			
1	Construction Noise Permit for the use of powered mechanical equipment to carry out construction works (including de-watering) from 19:00 to 23:00 at Works Area H.	Applied on 24 Jun 2011 (Re-applied on 23 Jul 2011)	Rejected on 14 Jul 2011
2	Construction Noise Permit for the use of powered mechanical equipment to carry out site dewatering works from 23:00 to 07:00 at Works Area H.	Applied on 23 Jun 2011 (Re-applied on 23 July 2011)	Rejected on 14 Jul 2011.
3	Construction Noise Permit for the use of powered mechanical equipment to carry out construction works (including de-watering) from 19:00 to 23:00 at	Applied on 27 Jul 2011	Under Assessment

Item	Item Description	Application Date	Permit Status
	Works Area G.		
4	Construction Noise Permit for the use of powered mechanical equipment to carry out site dewatering works from 23:00 to 07:00 at Works Area F.	Applied on 29 Jul 2011	Under Assessment
Contract 823A (Works Areas D, D1 and E)			
1	Water Discharge License under WPCO for Works Area D	14 Dec 2010	License granted on 7 Jul 2011 (Licence No. WT00009416-2011)
2	Water Discharge License under WPCO for Works Area E	2 Jun 2011	License granted on 7 Jul 2011 (Licence No. WT00009418-2011)
Contract 823B (Works Area D, Z and To Kau Wan Works Area)			
No updates in the reporting month			
Contract 824 (Works Area B and C)			
1	Construction Noise Permit for the use of PMEs other than Percussive Piling for Works Area B	23 May 2011	Permit granted on 2 Jun 2011 (Ref: GW-RN0180-1)
2	Water Discharge License under WPCO for Works Area C	19 Jan 2011	License granted on 23 Jun 2011 (Licence No.

Item	Item Description	Application Date	Permit Status
			WT00009182-2011)
Contract 825 (Works Area A and AA)			
1	Construction Noise Permit for TBM unloading	20 May 2011	Permit granted on 3 Jun 2011 (Ref: GW-RN0182-11 valid from 5 Jun 2011 to 6 Jun 2011)

Table 3-2 Summary of the status of permits, licences and notifications made, applied and approved under this Project during the previous and reporting month

4. SUMMARY OF EM&A REQUIREMENT

4.1 Air Quality

4.1.1 Air Quality Parameters

In accordance to the EM&A Manual, 24-hour Total Suspended Particulates (TSP) levels were measured at the 17 air monitoring locations in accordance with the EM&A Manual. Monitoring was undertaken at each monitoring location once per every 6 days. Information such as date of monitoring, duration, weather condition, equipment used and monitoring results shall be recorded on the field data sheet developed for the Project. Monitoring results are summarized in Section 5.

4.1.2 Monitoring Methodology and Calibration

Monitoring was undertaken to establish for 24-hour Total Suspended Particulates (TSP) at 17 monitoring locations in the vicinity of the Works Area A, B, C, D, E, F, G, H, J, L, P, Q, R, V1 and V2. Monitoring of 24-hour TSP was carried out using a high volume sampler (HVS) according to Part 50 Chapter 1 Appendix B, Title 40 of the Code of Federal Regulations of the USEPA.

The sampling procedure follows to that described Part 50 Chapter 1 Appendix B, Title 40 of the Code of Federal Regulations of the USEPA. TSP is sampled by drawing air through a conditioned, pre-weighed filter paper inside the high volume sampler at a controlled rate. After 24-hour sampling the filter paper with retained particles shall be collected and returned to HOKLAS accredited laboratory (ALS Technichem (HK) Pty Ltd) for drying in a desiccators followed by accurate weighing. TSP levels are calculated from the ratio of the mass of particulate retained on the filter paper to the total volume of air sampled.

The flow rate of the high volume sampler with mass flow controller was calibrated using an orifice calibrator. Initial calibration (five points) was conducted upon installation and prior to commissioning. Calibration was carried out every six months. the detail of calibration is shown in Table 4-1 below. The samplers shall be properly maintained. Prior to dust monitoring commencing, appropriate checks shall be made to ensure that all equipment and necessary power supply are in good working

condition.

Monitoring Station ID	Air Quality Monitoring Location	HVS Serial Number	Last Calibration Date
AM 1	Outside No. 142 Mai Po San Tsuen	467	4/7/2011
AM 2	Yau Tam Mei Village House	468	27/4/2011
AM 3	Kong Tai Road Village House	510	27/4/2011
AM 4	DD110 LOT 482, Wang Toi Shan	521	4/7/2011
AM 5	Leung Uk Tsuen Squats	1276	22/7/2011
AM 6	630 Sheung Tsuen	469	22/7/2011
AM 7	Tse Uk Tusen	1763	22/7/2011
AM 8	No. 306, Sheung Tsuen San Tsuen Village House	520	27/4/2011
AM 9	Sau Shan House, Cheung Shan Estate	529	22/6/2011
AM 10	Yau Ma Hom Resite Village	509	22/6/2011
AM 11	Chung Shun Knitting Centre	1707	15/2/2011
AM 12	Po Leung Kuk Tong Nai Kan College	520	2/6/2011
AM 13	St. Andrew Primary School	524	27/7/2011

Monitoring Station ID	Air Quality Monitoring Location	HVS Serial Number	Last Calibration Date
AM 14	Yaumati Catholic Primary School	407	27/7/2011
AM 15	Between Sorrento and The Waterfront	515	2/6/2011
AM 16	Tower 3, The Waterfront	1282	2/6/2011
AM 17	The Victoria Towers	528	2/6/2011

Table 4-1 Calibration details of HVS

4.1.3 Monitoring Location

According to the EM&A Manual, air quality monitoring was carried out at the locations as shown in Table 4-1 above. The monitoring locations are illustrated in Appendix D.

4.1.4 Action and Limit Levels

With reference to the baseline monitoring results, the Action and Limit Levels for the 24-hour TSP monitoring derived are shown in Table 4-2. In the case of exceedance of Action and/or Limit levels for air quality occur, the Event and Action Plan as stipulated the EM&A Manual shall be implemented.

Monitoring Station ID	24-hour TSP Level in μg/m^3	
	Action Level	Limit Level
AM 1	217.3	260
AM 2	179.4	260
AM 3	154.7	260
AM 4	148.6	260

Monitoring Station ID	24-hour TSP Level in μg/m^3	
	Action Level	Limit Level
AM 5	152.0	260
AM 6	145.6	260
AM 7	149.8	260
AM 8	158.1	260
AM 9	171.2	260
AM 10	174.8	260
AM 11	160.3	260
AM 12	162.5	260
AM 13	180.3	260
AM 14	158.2	260
AM 15	168.8	260
AM 16	155.9	260
AM 17	179.3	260

Table 4-2 Action and Limit Levels for Air Quality

4.2 Air-borne Noise

4.2.1 Noise Parameters

In accordance to the EM&A Manual, construction noise monitoring shall be conducted to obtain one set of 30-minute measurement at each monitoring station between 0700 and 1900 hours on normal weekdays at a frequency of once per week when construction activities are underway. The L_{eq}, L_{10} and L_{90} were also recorded at the specified interval.

4.2.2 Monitoring Methodology and Calibration

As referred to the Technical Memorandum (TM) issued under the NCO, sound level

meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. In this baseline monitoring, B&K 2250 sound level meters, which complies with the above-mentioned specifications, were used.

Immediately prior to and following each noise measurement the accuracy of the sound level meter should be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the difference between calibration levels obtained before and after the noise measurement is less than 1.0 dB.

The sound level meters and calibrator are verified by the certified laboratory or manufacturer at a regular interval to ensure they perform to the same level of accuracy as stated in the manufacturer's specifications. Detail of calibration is shown in Table 4-3 below:

Monitoring Station ID	**Noise Monitoring Location**	**Serial Number**	**Last Calibration Date**
Sound Level Meters			
CN 1	No. 142 Mai Po San Tsuen	2701830	28/12/2010
CN 2	Mai Po San Tsuen Village House	2701819	28/12/2010
CN 3	Yau Tam Mei Village House	2718893	23/5/2011
CN 4	Yau Tam Mei Village House	2718887	23/5/2011
CN 5	Kong Tai Road Village House	2718895	30/5/2011
CN 6	Kong Tai Road Village House	2718879	26/5/2011

Monitoring Station ID	Noise Monitoring Location	Serial Number	Last Calibration Date
CN 7	372 Tai Kong Po Tsuen	2718881	26/5/2011
CN 8	DD110 LOT 482, Wang Toi Shan	2718882	30/5/2011
CN 9	Leung Uk Tsuen Village House	2718889	3/6/2011
CN 10	DD110 LOT 482, Wang Toi Shan	2718891	16/6/2011
CN 11	182B, Wang Toi Shan San Tsuen	2718884	10/6/2011
CN 12	DD108, Nam Hing Lei, Wing Hing Wai	2718892	10/6/2011
CN 13	Tse Uk Tsuen	2718883	3/6/2011
CN 14	Tse Uk Tsuen	2718890	7/6/2011
CN 15	No. 305B - Sheung Tsuen San Tsuen Village House	2718885	7/6/2011
CN 16	DD 114 LOT 1405 Sheung Tsuen	2718888	13/6/2011
CN 18	Sau Shan House	2701831	13/1/2011
CN 19	Sun Fung Centre	2701821	10/1/2011
CN 20	VTC Kwai Chung Training Centre Complex	2718894	10/6/2011
CN 21	Po Leung Kuk Tong Nai Kan College	2701820	8/4/2011
CN 22	Block I, Lai Chi Kok Reception Centre	2709427	8/4/2011

Monitoring Station ID	Noise Monitoring Location	Serial Number	Last Calibration Date
CN 23	HKIVE Haking Wong Waterfront Annex	2701818	10/1/2011
CN 24	St. Andrew Primary School	2701825	17/1/2011
CN 25	St. Mary's Church Mok Hing Yiu College	2709428	13/4/2011
CN 26	Ying Wah College	2701822	13/1/2011
CN 27	Cheong Shun House, Nam Cheong Estate	2709426	13/4/2011
CN 28	Tower 6, Harbour Green	2701817	3/1/2011
CN 29	Yaumati Catholic Primary School	2701815	3/1/2011
CN 30	Man Cheong Street Refuse Collection Point	2701816	30/12/2010
CN 31	Tower 6, Sorrento	2701826	17/1/2011
CN 32	Tower 3, The Waterfront	2701823	30/12/2010
CN 33	Star Tower, The Arch	2701827	17/1/2011
CN 34	The Victoria Towers	2701829	6/1/2011
Calibrator			
Serial Number		**Last Calibration Date**	
N491111		8/12/2010	

Table 4-3 Calibration details of noise monitoring equipments

Note:

1. Due to school closure, monitoring at Tsuen Wan Lutheran School (CN 17) was temporarily suspended. Monitoring would be carried out subject to confirmation of noise sensitive use of the

building.

2. A correction factor has been applied at CN19 to take into account the noise barrier effect. The correction factor was agreed with IEC according to Section 3.11 of the EM&A Manual.

4.2.3 Monitoring Location

According to the EM&A Manual, noise quality monitoring was carried out at the locations as shown in Table 4-3 above. The monitoring locations are illustrated in Appendix D.

4.2.4 Action and Limit Levels

The Action and Limit Levels for the construction noise are shown in Table 4-4 below. In the case of non-compliance of Action and/or Limit level, the Event and Action Plan stipulated in the EM&A Manual shall be implemented.

Time Period	Action	Limit
0700-1900 hours on normal weekdays	When one documented complaint is received	75 dB(A) for residential premises
		70 dB(A) for school and 65 dB(A) during examination period

Table 4-4 Action and Limit Levels for Airborne Construction Noise

4.2.5 Review of baseline at CN 21

With reference to Baseline Monitoring Report, the baseline noise level at CN 21 would be reviewed regularly once every six months to confirm its validity and the results would be included in the EM&A report. Baseline monitoring was carried out in June and July for a consecutive of 14 days. One set of Leq (30 min) measurement was taken daily during the hours without any construction works at works area in the vicinity of CN 21. Dominant noise source at CN 21 during the time of baseline review measurement was identified as background traffic noise.

Date	Start time	End time	$L_{eq\ (30\ min)}$ dB(A)
27/6/2011	12:00 PM	12:30 PM	68
28/6/2011	Cancelled due to rain		
29/6/2011			
30/6/2011	12:00 PM	12:30 PM	**71**
1/7/2011	Cancelled due to rain		
2/7/2011	12:20 PM	12:50 PM	69
3/7/2011	12:15 PM	12:45 PM	68
4/7/2011	12:10 PM	12:40 PM	70
5/7/2011	12:10 PM	12:40 PM	69
6/7/2011	12:15 PM	12:45 PM	69
7/7/2011	Equipment error		
8/7/2011	12:05 PM	12:35 PM	69
9/7/2011	12:15 PM	12:45 PM	68
10/7/2011	11:55 PM	12:25 PM	68
11/7/2011	Cancelled due to rain		
12/7/2011			
13/7/2011	12:00 PM	12:30 PM	68
14/7/2011	12:05 PM	12:35 PM	68
15/7/2011	12:10 PM	12:40 PM	69
16/7/2011	Cancelled due to rain		
17/7/2011	12:05 PM	12:35 PM	71
Average Leq (30-min), dB(A)			69

Table 4-5: Review of baseline monitoring results at CN 21

As revealed from the tables above, the revised average daytime baseline noise level at CN 21 is slightly lower than the previously recorded baseline level (70 dB(A)). The revised baseline noise levels would be adopted as reference for impact monitoring in the coming 6 months before the next half-yearly review of baseline noise level.

4.3 Ground-borne Noise

No ground-borne noise monitoring was conducted in the reporting month since no operation of TBM was carried out.

4.4 Ecological Monitoring

4.4.1 Ecological Monitoring on Avifaunal Communities

Monitoring methodology

In accordance with the Ecological Monitoring Plan, avifaunal communities would be surveyed quantitatively by transect count or/and point count method covering the vicinity of the works area as shown in Table 4-6 below. Birds heard or seen within the survey area would be identified to species level and counted. The nature of construction works within works area conducting during each impact monitoring would also be recorded. Weather condition and other noticeable activities occurring within or in the vicinity of the survey areas would be recorded. The impact monitoring results would be compared to the baseline data collected before construction. Should any unpredicted indirect ecological impacts arising from the Project be detected, remedial measures would be implemented by the Contractor.

Monitoring location, frequency and duration

In accordance with the EM&A Manual and Ecological Monitoring Plan, ecological monitoring should be conducted at Works Area in MPV, TPP, SSS/ERS, TUW and PHV. With the hoarding erection completed and construction works at MPV, TPP and PHV commenced, ecological monitoring on monthly basis was commenced accordingly. The location, frequency and duration of ecological monitoring at MPV, TPP, SSS/ERS, TUW and PHV are shown in the table below and figures in Appendix D.

Works Area	**Survey Site**	**Monitoring Location**	**Monitoring Frequency**	**Monitoring Duration**
Mai Po Ventilation Building Works Area (MPV)	MPV-1	• Fishponds in Wetland Conservation Area (WCA) within 500 m from the boundary of MPV works area	Monthly	• During construction phase of MPV works area

Works Area	**Survey Site**	**Monitoring Location**	**Monitoring Frequency**	**Monitoring Duration**
Access road leading to TPP	TPP-1/2/3	• The whole alignment of drainage channel KT5 (TPP-1) • The section of drainage channel 95CD along the proposed alignment of access upgrading (TPP-2) • The whole alignment of abandoned meander of conservation interest 43CD-1 (TPP-3)	Monthly	• During upgrading and operation of access road for construction phase activities
Access road leading to SSS / ERS	SSS-2a [1]	• The whole alignment of abandoned meanders of conservation interest 95CD-4	Monthly	• During upgrading and operation of access road for construction phase activities [1]
	SSS-3	• Agricultural land within 500 m from the boundary of SSS/ ERS works area between Shek Kong Road and Kam Sheung Road (SSS-3)	Monthly	• During construction phase of SSS / ERS works area

Works Area	Survey Site	Monitoring Location	Monitoring Frequency	Monitoring Duration
Tse Uk Tsuen Works Area (TUW)	TUW – 1/2 (TUW-2 grouped with PHV-1 due to overlapping of survey area)	• Agricultural land within 500 m from the boundary of TUW works area to the south of Kam Sheung Road (TUW-1) • Woodland in Conservation Area (CA) within 500 m from the boundary of TUW works area (TUW-2)	Monthly	• During construction phase of TUW works area
Pat Heung Ventilation Building Works Area (PHV)	PHV-1 (grouped with TUW-2 due to overlapping of survey area)	• Woodland in CA within 500m from the boundary of PHV works area	Monthly	• During construction phase of PHV works area

Table 4-6 Requirement of Construction Impact Monitoring for Avifaunal Group

Note: 1. Despite that upgrading of access road leading to SSS has yet commenced, monthly monitoring was commenced due to commencement of construction activities in the vicinity of SSS-2a.

4.4.2 Monitoring of impact at fishpond due to noise/vibrations

In accordance with the Monitoring and Emergency Response Plan, during construction stage, air-borne noise monitoring should be carried out at the respective monitoring location at nearby fishpond (Appendix D) when there are project-related construction activities being undertaken within a radius of 300m from the monitoring location. One set of 30-minute measurement at a frequency of once a week when the above-mentioned construction activities are underway.

As operation of TBM underneath fishponds in Mai Po is not expected in the coming reporting months, no monitoring of ground-borne noise was carried out.

Monitoring of impact due to air-borne noise

Monitoring methodology

With reference to the Monitoring and Emergency Response Plan, the noise acceptance criteria of 75 dB(A) was adopted for the assessment of adverse impact to fisheries due to air-borne noise.

Monitoring location, frequency and duration

The nearest fish-pond located in the vicinity of the works area in Mai Po as shown in Appendix D was identified as a representative air-borne and ground-borne noise/vibration monitoring location.

During construction stage, routine air-borne noise monitoring would be carried out at the respective monitoring location when there are project-related construction activities being undertaken within a radius of 300m from the monitoring station. One set of 30-minute measurement at a frequency of once a week when the above-mentioned construction activities are underway.

Action and Limit Levels

The Action and Limit levels for air-borne noise are defined in the table below. Should non-compliance of the noise quality criteria occur, actions in accordance with the Table 4-7 as should be carried out.

Time Period	**Action Level**	**Limit Level**
All time period	When one documented complaint related to adverse impact to fisheries from fish-pond operator or any abnormal ecological monitoring results	75 dB(A) for air-borne noise

Table 4-7: Action and Limit Level for potential impact at fishpond due to air-borne noise

4.5 Landscape and Visual

Monitoring of the implementation of the tree protection measures during construction phase was conducted in accordance with the requirements of EP condition 2.15 (iv). The landscape and visual monitoring and auditing would be conducted once a month throughout the construction stage and covering the entire project site areas.

4.6 Cultural Heritage

4.6.1 Archaeology

Further archaeological investigation was commenced at Shek Kong Stabling Sidings (SSS) in accordance with the Archaeological Action Plan.

No monitoring and reporting is required at Lung Kwu Sheng Tan (LKST) since construction have not started.

4.6.2 Built Heritage

No monitoring was carried out at ex-Lai Chi Kok Hospital (LCKH) since no construction nearby LCKH in the reporting month.

Vibration monitoring at Cheung Yuen (LET-06) was conducted in report month as construction works were carried out within the 100m buffer area in accordance with the Vibration Monitoring Plan which was agreed with AMO. Vibration level at Cheung Yuen should be controlled to an acceptable level of 25mm/s during the vibration monitoring.

Calibrated vibration and overpressure monitors, Minimate Plus are used for the vibration monitoring at Cheung Yuen. When construction works are within 50m and between 50m and 100m from Cheung Yuen, monitoring will be conducted twice per day and once per week respectively at two specified monitoring locations

4.7 Landfill Gas

No monitoring was carried out in this reporting month since there was no construction within the Ngau Tam Mei Landfill (NTML) and Gin Drinker Bays Landfill (GDBL) consultation zone.

5. MONITORING RESULT

5.1 Air Quality

The monitoring schedule is shown in Appendix E. Results of 24-hour TSP level and the graphical presentation of monitoring results are shown in Appendix F.

In the reporting month, there was no exceedance of 24-hr TSP Action Level and Limit Level.

5.2 Noise

The monitoring schedule is shown in Appendix E. Results of measured noise level, in terms of $L_{eq(30min)}$ and graphical presentations are presented in Appendix F.

In the reporting month, noise exceedances of air-borne noise Limit Level were recorded at Wang Toi Shan (CN 8) on 14 Jul 2011; No. 305B - Sheung Tsuen San Tsuen Village House (CN 15) on 18 Jul 2011, HKIVE Haking Wong Waterfront Annex (CN 23) on 6 and 20 Jul 2011; Sorrento (CN 31) on 26 Jul 2011; The Waterfront (CN 32) on 6, 14, 21 and 28 Jul 2011 and The Arch (CN 33) on 26 Jul 2011.

For the noise exceedance at CN 8, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. Upon investigation, the exceedance might possible be due to the drilling works by 823A Contractor. The Contractor was requested to provide noise mitigation measures to minimize the noise impact.

For the noise exceedance at CN 15, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. Upon investigation, the exceedance were mainly caused by the renovation work of the village house naerby.

Regarding the noise exceedances at CN 23, actions identified in the Event and

Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. The noise exceedance was caused by the demolition work and pile removal work by 805 contractors. Noise mitigation measure had been implemented for noise suppression.

For the noise exceedance at CN 31 at Sorrento, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. Upon investigation, the exceedance may possibly caused by the construction works of 811B and 810B carried out at the nearby work site and noise mitigation measures have been enhanced to avoid further noise exceedance.

For the noise exceedances at The Waterfront (CN 32) and The Arch (CN 33) in West Kowloon, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractors were informed of the exceedances. The investigation result revealed that noise source may possibly due to works by 803A, 803B, 803D and 810B Contractors. Additional noise mitigation measures proposed by the Contractor were reviewed by IEC and ET and implemented by the 803A, 803B, 803D and 810B Contractors to minimize the noise impact. All contractors in WKT works area were reminded to enhance the noise mitigation measures to comply with the statutory requirement and minimize noise nuisance to the nearby NSRs.

In addition, there was one noise exceedance of Action Level triggered due to noise complaint during daytime hours received in the reporting month. Please refer to Section 7 for details of complaint.

5.3 Ecological Monitoring

5.3.1 Ecological Monitoring on Avifaunal Communities

Ecological monitoring at MPV

Monthly avifauna monitoring at MPV work site was conducted on 14 July 2011. The weather conditions and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring were summarized in Table 5-1. The MPV-1 survey site comprised about 20 fishponds with most of them being actively managed (Figure 1 in Appendix D refers). Commonly observed pond

management activities during the monitoring include pond aeration, removal of bund weeds and fish feeding. Ongoing construction activities were also recorded at the works area of the project "Proposed Comprehensive Development at Wo Shang Wai, Yuen Long" (hereinafter to be referred to as "Wo Shang Wai Project") located near Point Count Location MPV-1/P9. The bird species and their abundance recorded during the avifauna monitoring for the reporting month are presented in Appendix G.

Date	**Weather Conditions**	**Noticeable Activities in the MPV-1 Survey Site**
14 July 2011	Overcast	- Pond aeration

Table 5-1 Weather condition and noticeable activities observed in the MPV-1 survey site during monitoring in the reporting month

A total of 235 individuals from 26 avifauna species were recorded from the Point Count Locations at MPV-1 in the reporting month (Table 5-2 refers). The total number of species recorded during the monitoring was 27. The population of the avifauna recorded mainly consisted of ardeids (e.g. egrets and herons) and widespread resident species (e.g. Spotted Dove, Yellow-bellied Prinia, Eurasian Tree Sparrow and Crested Myna). Other recorded waterbirds and wetland-dependent species include Little Grebe, Black Kite and White-breasted Waterhen Detailed records of avifauna at MPV-1 survey site are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline data from August to October 2009. The number of species and abundance recorded in the reporting month remains similar to that of the baseline.

The monitoring results indicated the fishponds within the survey area were utilized by a large number of waterbirds in the reporting month during the monitoring. No significant fluctuation in the number of species and abundance of avifauna was observed. Therefore, no adverse indirect impacts arising from the Project were identified.

Survey	MPV-1	
	No. of Species	Abundance
14 July 2011	26	235
August to October 2009 [1]	24	230

Note:

1. Monthly average obtained from baseline bird survey.

Table 5-2 Number of species and abundance of avifauna recorded in the reporting month during bird survey at the point count locations of the MPV-1 survey site

Month	Total Number of Species Recorded [1,2]
14 July 2011	27 (4)
August to October 2009 [3]	24 (5)

Note:

1. Total number of species recorded included the avifauna recorded from both point count locations and walk transect.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-3 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the MPV-1 survey site

Ecological monitoring at Tai Kong Po (TPP-1)

The avifauna monitoring location for the proposed works area of the TPP access road was sub-divided into three survey sites namely TPP-1, TPP-2 and TPP-3. The TPP-1 survey site is a drainage channel (KT5) with gabion / masonry banks at upper portion. The rest of the channel is trapezoidal with vegetated grasscrete banks on both sides of the channel. The downstream end of the channel joins up with a main drainage channel (95CD) (Figure 3 in Appendix D refers).

The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-4. The bird species and their abundance recorded during the avifauna monitoring for the

reporting month are presented in Appendix G.

Date of Monitoring	Weather Condition	Noticeable Activities Observed in the TPP-1 Survey Site
14 July 2011	Overcast	• Excavation works near Point Count Location TPP-1/P4

Table 5-4 Weather Condition and Noticeable Activities Observed in the TPP-1 Survey Site during the Monitoring in the Reporting Month

A total of 130 individuals from 22 avifauna species were recorded from the Point Count Locations at TPP-1 in the reporting month (Table 5-5 refers). The total number of species recorded during the monitoring was 24. The population of the avifauna recorded mainly consisted of residents species (e.g. Spotted Dove, Yellow-bellied Prinia, Eurasian Tree Sparrow and Crested Myna). Other recorded waterbirds include ardeids (e.g. Little Egret and Chinese Pond Heron) White-breasted Waterhen and sandpipers (e.g. Green Sandpiper and Common Sandpiper). . It is typical in most lowland streams of Hong Kong (polluted and/or channelized at their lower courses) that lowland wetland bird species such as Chinese Pond Heron, White-breasted Waterhen, Common Kingfisher and Grey Wagtail could be found in low densities (Wong *et al*., 2009)[1]. Bird activity in channelized streams is largely restricted to exploiting food resources, typically fish or insects (Wong *et al*., 2009). Detailed records of avifauna at TPP-1 are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline bird survey conducted from August to October 2009. The number of bird species recorded from Point Count Locations and the total number of species are higher than the baseline results. This is explained by the presence of White-shouldered Starling and resident species such as, Rock Dove, Chinese Bulbul, Plain Prinia, Common Tailorbird and Common Myna. However, the abundance of bird species recorded from Point Count Locations in June 2011 was lower than the

[1] Wong, L.C., Lam, W.Y. and Ades, W.J., 2009. *Ecology of the Birds of Hong Kong*. Kadoorie Farm and Botanic Garden, Hong Kong Special Administration Region.

baseline results. The drop in abundance was due to the decreased record or absence of waterbirds (e.g. Little Egret, Green Sandpiper and Wood Sandpiper) and the absence of Scaly-breasted Munia. Investigation was being carried out and the result of which would be included in the report in coming months. The situation would be closely monitored by ET and IEC.

Survey Period	TPP-1 Survey Site	
	No. of Bird Species	Abundance of Bird Species
14 July 2011	22	130
August to October 2009 [1]	15	174

Note:

1. Monthly average obtained from baseline bird survey.

Table 5-5 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the Point Count Locations of the TPP-1 Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
14 July 2011	24 (2)
August to October 2009 [3]	15 (4)

Note:

1. Total number of species recorded included the avifauna recorded from both point count locations and walk transect.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-6 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the TPP-1 Survey Site

Ecological monitoring at Tai Kong Po (TPP-2)

The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-7. The TPP-2 survey site covered a section of main drainage channel 95CD, which is a concrete trapezoidal channel with grasscrete banks. Plantation of native or landscape vegetation was observed along the embankment of the channel (Figure 2 in Appendix D refers). The bird species and their abundance recorded during the avifauna monitoring for the reporting month are presented in Appendix G.

Date of Monitoring	Weather Condition	Noticeable Activities Observed in the TPP-2 Survey Site
14 July 2011	Overcast	• No project-related construction activities located in the vicinity

Table 5-7 Weather Condition and Noticeable Activities Observed in the TPP-2 Survey Site during the Monitoring in the Reporting Month

A total of 95 individuals from 13 avifauna species were recorded from the Point Count Locations at TPP-2 in the reporting month (Table 5-8 refers). The total number of species recorded during the monitoring was 14. The population of the avifauna recorded mainly consisted of Little Ringed Plover, White Wagtail and residents (e.g. Scaly-breasted Munia and Eurasian Tree Sparrow).. Other recorded waterbirds and wetland-dependent species included Little Egret, Common Sandpiper and Common Kingfisher.. It is typical in most lowland streams of Hong Kong (polluted and/or channelized at their lower courses) that lowland wetland bird species such as Chinese Pond Heron, White-breasted Waterhen, Common Kingfisher and Grey Wagtail could be found in low densities (Wong *et al*., 2009). Detailed records of avifauna at TPP-2 are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline data from August to October 2009. The number of bird species at the Point Count Locations of TPP-2 and the total number of species recorded from TPP-2 survey site in the reporting month were of similar magnitude as the baseline results (Table 5-8 and Table 5-9 refer). There was an increase in the abundance due to the increased numbers of Eurasian Tree Sparrow recorded.

The monitoring results indicated the main drainage channel within the survey area was utilized by typical lowland stream birds in the reporting month during the monitoring. No significant fluctuation in the number of species and abundance of avifauna was observed. Therefore, no adverse indirect impacts arising from the Project were identified.

Survey Period	TPP-2 Survey Site	
	No. of Bird Species	Abundance of Bird Species
14 July 2011	13	95
August to October 2009 [1]	14	66

Note:

1. Monthly average obtained from baseline bird survey.

Table 5-8 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month. Avifauna Monitoring at the Point Count Locations of the TPP-2 Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
14 July 2011	14 (1)
August to October 2009 [3]	16 (3)

Note:

1. Total number of species recorded included the avifauna recorded from both point count locations and walk transect.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-9 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the TPP-2 Survey Site

Ecological monitoring at Tai Kong Po (TPP-3)

The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-10. The TPP-3 survey site is an abandoned meander (43CD-1) of conservation interest with natural banks and substratum. The earthen banks of the meander were mostly dominated by grasses and weeds. The section near point count location TPP-3/P1 was found to be usually wet though the water was quite stagnant. Due to its close proximity to a village access road of Kam Hing Wai and Shui Mei Tsuen, this section of meander was subject to higher disturbance from villagers and traffic. Point count

locations TPP-3/P2 and TPP-3/P3 were only seasonally wet (Figure 2 in Appendix D refers). The bird species and their abundance recorded during the avifauna monitoring for the reporting month are presented in Appendix G.

Date of Monitoring	**Weather Condition**	**Noticeable Activities Observed in the TPP-3 Survey Site**
14 July 2011	Overcast	• No project-related construction activities located in the vicinity

Table 5-10 Weather Condition and Noticeable Activities Observed in the TPP-3 Survey Site during the Monitoring in the Reporting Month

A total of 48 individuals from 15 avifauna species were recorded from the Point Count Locations at TPP-3 in the reporting month (Table 5-11 refers). The total number of species recorded during the monitoring was 15. The population of the avifauna recorded consisted of widespread resident species (e.g. Red-whiskered Bulbul, Masked Laughingthrush and Yellow-bellied Prinia). Other recorded waterbirds include White-breasted Waterhen. It is typical in most lowland streams of Hong Kong (polluted and/or channelized at their lower courses) that lowland wetland bird species such as Chinese Pond Heron, White-breasted Waterhen, Common Kingfisher and Grey Wagtail could be found in low densities (Wong *et al*., 2009). Detailed records of avifauna at TPP-3 are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline data from August to October 2009. The number of bird species,abundance recorded from the Point Count Locations of TPP-3 and the total number of species recorded from TPP-3 survey site in the reporting month were higher than the baseline results (Table 5-11 and Table 5-12 refer). Survey records in the reporting month demonstrate an increase in abundance of common resident species recorded such as Red-whiskered Bulbul, Masked Laughingthrush and Yellow-bellied Prinia..

The monitoring results indicated the abandoned meander within the survey area was utilized by typical lowland stream birds in the reporting month during the monitoring. An increase in the number of resident species and their abundance of avifauna was observed. Therefore, no adverse indirect impacts arising from the

Project were identified.

Survey Period	TPP-3 Survey Site	
	No. of Bird Species	Abundance of Bird Species
14 July 2011	15	48
August to October 2009 [1]	4	7

Note:

1. Monthly average obtained from baseline bird survey.

Table 5-11 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the Point Count Locations of the TPP-3 Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
14 July 2011	15 (0)
August to October 2009 [3]	3 (1)

Note:

1. Total number of species recorded included the avifauna recorded from both point count locations and walk transect.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-12 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the TPP-3 Survey Site

Ecological monitoring at Shek Kong Stabling Sidings (SSS-2a)

Monthly avifauna monitoring at SSS-2a was conducted during the construction work in the vicinity of SSS-2a. Construction in the vicinity of SSS-1/2b was yet commenced and ecological monitoring would be conducted according to the construction programme. SSS-2a survey site is an abandoned meander (95CD-4) of conservation interest located in the north of Wan Toi Shan. The meander is adjacent to car repairing workshops and garage. Riparian vegetation was well established although some areas of the banks were lined with concrete. The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-13

Date of Monitoring	Weather Condition	Noticeable Activities Observed in the SSS-2a Survey Site
14 July 2011	Overcast	• Construction works in the vicinity of Point Count Location SSS-2a/P1

Table 5-13 Weather Condition and Noticeable Activities Observed in the SSS-2a Survey Site during the Monitoring in the Reporting Month.

A total of 26 individuals from 11 avifauna species were recorded from the Point Count Locations at SSS-2a in the reporting month (Table 5-14 refers). The total number of species recorded during the monitoring was 11. The population of the avifauna recorded consisted mainly of widespread resident species (e.g. Oriental Magpie Robin, Masked Laughingthrush and Japanese White-eye).Detailed records of avifauna at SSS-2a are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline data from August to October 2009. The number of bird species from the Point Count Locations of SSS-2a and the total number of species recorded from SSS-2a survey site in the reporting month were of similar magnitude as the baseline results (Table 5-14 and Table 5-15 refer). An increase in abundance was recorded from the Point Count Locations of SSS-2a, mainly due to the presence of common resident species such as, Masked Laughingthrush and Eurasian Tree Sparrow.

The monitoring results indicated the abandoned meander within the survey area was utilized by typical lowland stream birds in the reporting month during the monitoring. No significant fluctuation in the number of species and abundance of avifauna was observed. Therefore, no adverse indirect impacts arising from the Project were identified.

Survey Period	SSS-2a Survey Site	
	No. of Bird Species	Abundance of Bird Species
14 July 2011	11	26
August to October 2009 [1]	6	15

Note:

1. Monthly average obtained from baseline bird survey.

Table 5-14 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the Point Count Locations of the SSS-2a Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
14 July 2011	11 (0)
August to October 2009 [3]	6 (1)

Note:

1. Total number of bird species recorded included the avifauna recorded from point count locations only as there is no walk transect for SSS-2a survey site.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-15 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the SSS-2a Survey Site

Ecological monitoring at Shek Kong Stabling Sidings (SSS-3)

Monthly avifauna monitoring at SSS-3 work site was conducted on 14 July 2011 during the construction of SSS / ERS. Construction in the vicinity of SSS-1/2b was yet commenced and ecological monitoring would be conducted according to the construction programme. The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-16. The farmland in SSS-3 survey site displayed a distinctive seasonal crop rotation pattern between wet agriculture (*Ipomoea aquatica*) in summer season and dry agriculture (seasonal flowers such as *Gladiolus gandavensis*) in winter season (Figure 4 in Appendix D refers). The bird species and their abundance recorded during the avifauna monitoring for the reporting month are presented in Appendix G.

Date of Monitoring	Weather Condition	Noticeable Activities Observed in the SSS-3 Survey Site
14 July 2011	Overcast	• Construction work at Point Count Location SSS-3/P8 • Both wet and dry agricultural activities were observed such as farming of vegetables and ornamental flowers

Table 5-16 Weather Condition and Noticeable Activities Observed in the SSS-3 Survey Site during the Monitoring in the Reporting Month

A total of 185 individuals from 25 avifauna species were recorded from the Point Count Locations at SSS-3 in the reporting month (Table 5-17 refers). The total number of species recorded during the monitoring was 27. The population of the avifauna recorded mainly consisted of common resident species (e.g. Red-whiskered Bulbul, Masked Laughingthrush, Eurasian Tree Sparrow and Crested Myna). A White-shouldered Starling nest was identified near Point Count Location P11. It was found that the dominant species present in dry farmland included for example Spotted Dove, Barn Swallow, Eurasian Tree Sparrow, Black-collared Starling and Crested Myna. Detailed records of avifauna at SSS-3 are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline data from August to October 2009. The number of bird species and abundance recorded from the Point Count Locations of SSS-3 and the total number of species recorded from SSS-3 survey site in the reporting month were of similar magnitude as the baseline results.

The monitoring results indicated the agricultural lands within the survey area were utilized by typical bird species found in dry farmland in the reporting month during the monitoring. No significant fluctuation in the number of species and abundance of avifauna was observed. Therefore, no adverse indirect impacts arising from the Project were identified.

Survey Period	SSS-3 Survey Site	
	No. of Bird Species	Abundance of Bird Species
14 July 2011	25	185
August to October 2009 [1]	24	188

Note:

1. Monthly average obtained from baseline bird survey.

Table 5-17 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the Point Count Locations of the SSS-3 Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
14 July 2011	27 (3)
August to October 2009 [3]	24 (3)

Note:

1. Total number of species recorded included the avifauna recorded from both point count locations and walk transect.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-18 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the SSS-3 Survey Site

Ecological monitoring at PHV and TUW

Monthly avifauna monitoring at TUW-1 work site was conducted on 21 July 2011 during the construction of TUW. The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-19. The TUW-1 survey site encompassed a large piece of agricultural land located to the south of Kam Sheung Road (i.e. Tse Uk Tsuen). The agricultural land in TUW-1 survey site shared the habitat characteristics of SSS-3 survey site. Similar seasonal alternation between wet and dry agriculture was also recorded from TUW-1 survey site (Figure 5 in Appendix D refers). The bird species and their abundance recorded during the avifauna monitoring for the reporting month are presented in Appendix G.

Date of Monitoring	Weather Condition	Noticeable Activities Observed in the TUW-1 Survey Site
21 July 2011	Sunny	• Excavation works near Point Count Location TUW-1/P1. • Both wet and dry agricultural activities were observed such as farming of vegetables and ornamental flowers

Table 5-19 Weather Condition and Noticeable Activities Observed in the TUW-1 Survey Site during the Monitoring in the Reporting Month

A total of 269 individuals from 29 avifauna species were recorded from the Point Count Locations at TUW-1 in the reporting month (Table 5-20 refers). The total number of species recorded during the monitoring was 31. The population of the avifauna recorded mainly consisted of residents (e.g. Spotted Dove, Red-whiskered Bulbul, Chinese Bulbul, Oriental Magpie Robin, Yellow-bellied Prinia and Scaly-breasted Munia). Other recorded waterbirds included Little Egret, Chinese Pond Heron, White-breasted Waterhen and sandpipers (e.g. Green Sandpiper and Common Sandpiper). A White-shouldered Starling nest was identified near Point Count Location TUW-1/P3. It was found that the dominant species present in dry farmland included Crested Myna, Spotted Dove, Barn Swallow, Eurasian Tree Sparrow and Black-collared Starling. Detailed records of avifauna at TUW-1 are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season data from August to October 2009. The number of bird species recorded from the Point Count Locations of TUW-1, and the total number of species recorded from TUW-1 survey site in the reporting month were of similar magnitude as the baseline results (Table 5-20 and Table 5-21 refer). Meanwhile, higher bird abundance was recorded in the reporting month. The increase in abundance in July 2011 was mainly composed of common resident species such as, Red-whiskered Bulbul, Chinese Bulbul, Yellow-bellied Prinia and Scaly-breasted Munia.

The monitoring results indicated the agricultural lands within the survey area were utilized by typical bird species found in dry farmland in the reporting month during

the monitoring. An increase in abundance of common resident species was observed. Therefore, no adverse indirect impacts arising from the Project were identified.

Survey Period	TUW-1 Survey Site	
	No. of Bird Species	Abundance of Bird Species
21 July 2011	29	269
August to October 2009 [1]	22	130

Note:
1. Monthly average obtained from baseline bird survey.

Table 5-20 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the Point Count Locations of the TUW-1 Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
21 July 2011	31 (1)
August to October 2009 [3]	22 (3)

Note:

1. Total number of species recorded included the avifauna recorded from both point count locations and walk transect.
2. The numbers in brackets denote the number of species of conservation interest.
3. Monthly average obtained from baseline bird survey.

Table 5-21 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the TUW-1 Survey Site

Since the extent of PHV-1 survey site is overlapped with that of TUW-2 survey site, the survey data of the TUW-2 and PHV-1 survey sites were reported collectively. Monthly avifauna monitoring at TUW-2 and PHV-1 survey site was conducted on 24 June 2011 during the construction of TUW and PHV. The weather condition and other noticeable activities occurring within or in the vicinity of the survey area during the monitoring are summarized in Table 5-22. The TUW-2 and PHV-1 survey site comprised the woodland in Conservation Area (CA) within 500 m from the boundary of the PHV works area (Figure 6 in Appendix D refers). The bird species and their abundance recorded during the avifauna monitoring for the reporting month are presented in Appendix G.

Date of Monitoring	Weather Condition	Noticeable Activities Observed in the TUW-2 and PHV-1 Survey Site
21 July 2011	Sunny	• Construction works in the works area

Table 5-22 Weather Condition and Noticeable Activities Observed in the TUW-2 and PHV-1 Survey Site during the Monitoring in the Reporting Month

A total of 15 individuals from 9 avifauna species were recorded from the Point Count Locations at TUW-2 and PHV-1 in the reporting month (Table 5-23 refers). The total number of species recorded during the monitoring was 20. The population of the avifauna recorded consisted largely of residents (e.g. Red-whiskered Bulbul and Chinese Bulbul). It is typical that the forest bird community in Hong Kong is dominated by a few habitat-generalist species, including Chinese Bulbul, Red-whiskered Bulbul, Common Tailorbird and Japanese White-eye (Wong *et al*., 2009). Detailed records of avifauna at TUW-2 and PHV-1 are presented in Appendix G.

The monitoring results in the reporting month were compared against the wet season results of the baseline data from August to October 2009. The number of bird species and abundance recorded from the Point Count Locations of TUW-2 and PHV-1 in the reporting month were of similar magnitude as the baseline results (Table 5-23 and Table 5-24 refer). The total number of species recorded from TUW-2 and PHV-1 survey site was higher than the baseline result, this is due to the presence of residence species such as Grey-chinned Minivet, Scarlet Minivet, Blue Whistling Thrush, Masked Laughingthrush, Chinese Hwamei, Fork-tailed Sunbird and Japanese White-eye.

The monitoring results indicated the woodland within the survey area was utilized by typical forest birds in the reporting month during the monitoring. No significant fluctuation in the number of species and abundance of avifauna was observed. Therefore, no adverse indirect impacts arising from the Project were identified.

Survey Period	TUW-2 and PHV-1 Survey Site	
	No. of Bird Species	Abundance of Bird Species
21 July 2011	9	15
August to October 2009 [1]	7	14

Note:
1. Monthly average obtained from baseline bird survey.

Table 5-23 Number of Bird Species and Abundance of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the Point Count Locations of the TUW-2 and PHV-1 Survey Site

Survey Period	Total Number of Bird Species Recorded [1,2]
21 July 2011	20 (1)
August to October 2009 [3]	10 (0)

Note:

1. Total number of bird species recorded included the avifauna recorded from both point count locations and walk transect.

2. The numbers in brackets denote the number of species of conservation interest.

3. Monthly average obtained from baseline bird survey.

Table 5-24 Total Number of Bird Species Recorded in the Reporting Month Avifauna Monitoring at the TUW-2 and PHV-1 Survey Site

5.3.2 Monitoring of impact at fishpond due to noise

In accordance with the Monitoring and Emergency Response Plan, impact noise monitoring was conducted at fish pond on weekly basis for assessment of impact at fishponds due to noise. The results are displayed in the table below. It was revealed from the monitoring results that all monitoring results were within the Limit Level of 75 dB(A). Based on the monitoring results, there was no adverse impact at fishpond due to noise.

Monitoring Date	L_{eq}, dB(A)
2/7/2011	59

Monitoring Date	L_{eq}, dB(A)
5/7/2011	55
16/7/2011	55
21/7/2011	49
28/7/2011	56

Table 5-25 Noise monitoring results at fishpond in Mai Po

5.4 Waste Management

The quantities of waste disposed from this Project during the reporting month and the previous 2 months are summarized in the following table:

Reporting Month	Inert C&D [1]Materials (tonnes)	Non-inert C&D [2]Materials (tonnes)	Chemical Waste (Litre)
Contract 802[4]			
May 2011	2028.0	6.0	200
June 2011	1970.0	4.0	0
July 2011	2671.0	0	0
Contract 803A			
May 2011	6858.9	13.1	1600
June 2011	5753.9	21.5	800
July 2011	365.8	23.1	800
Contract 803B			
May 2011	3174.9	4.7	0
June 2011	2860.1	5.2	0
July 2011	2667.6	5.6	0
Contract 803D			
May 2011	1191.5	0	800
June 2011	480.2	1.3	0
July 2011	0.0	0	0
Contract 805			
May 2011	948.1	0	0

Reporting Month	**Inert C&D [1]Materials (tonnes)**	**Non-inert C&D [2]Materials (tonnes)**	**Chemical Waste (Litre)**
June 2011	309.0	0	0
July 2011	1077.5	0	0
Contract 810B[5]			
May 2011	66979.0	49.6	0
June 2011	10549.0	26.1	0
July 2011	7147.0	16.3	0
Contract 811A			
May 2011	8543.1	22.3	0
June 2011	5512.1	22.3	600
July 2011	7519.4	28.3	36
Contract 811B			
May 2011	22273.5	31.8	600
June 2011	17724.1	31.5	800
July 2011	8935.0	31.2	600
Contract 820[6]			
May 2011	33459.0	25.7	0
June 2011	2595.7	182.6	0
July 2011	8717.2	33.6	0
Contract 821[7]			
May 2011	20895.7	6.0	0
June 2011	2152.4	3.7	0
July 2011	321234.1	3.4	0
Contract 822[8]			
May 2011	48458.8	31.3	0
June 2011	43449.8	18.5	400
July 2011	37460.3	26.9	600
Contract 823A[9]			
May 2011	1617.5	232.2	0
June 2011	6386.3	7.9	0
July 2011	7338.1	30.4	0
Contract 823B[10]			
May 2011	52858.6	192.2	0
June 2011	81168.4	290.3	0
July 2011	70930.4	231.9	0.8

Reporting Month	**Inert C&D [1]Materials (tonnes)**	**Non-inert C&D [2]Materials (tonnes)**	**Chemical Waste (Litre)**
Contract 824			
May 2011	3265.0	986.0	0
June 2011	5061.0	85.0	0
July 2011	4030.0	40.0	0
Contract 825[11]			
May 2011	6901.0	2.6	0
June 2011	11691.3	21.3	0
July 2011	5808.9	21.9	0

Table 5-26 Summary of construction waste generated and disposed

Note:

1. Inert C&D materials include bricks, concrete, building debris, rubble and excavated soil.
2. Non-inert C&D materials include steel, paper / cardboard packaging waste, plastics and other wastes such as general refuse.
3. Alternative disposal site for inert C&D Material from 802 include TPTL No. 187, Pak Shek Kok, Tai Po, N.T.
4. Alternative disposal sites for inert C&D Material from 810B include Central-Wan Chai Bypass (Typhoon Shelter and HKCEC) and Zhongshan Torch Hi-Tech Zone.
5. Alternative disposal sites for inert C&D Material from Contract 820 include Contract HY/2009/11 and Contract HK12/02 CRIII.
6. Alternative disposal sites for inert C&D Material from Contract 821 include Contract HY/2009/11 , Pak Sha Tau Quarry, Zhuhai, China.
7. Alternative disposal sites for inert C&D Material from Contract 822 include Lam Tei Quarry and WENT landfill
8. Alternative disposal sites for inert C&D Material from Contract 823A include NENT landfill (re-used as cover material) and Wo Shang Wai.
9. Alternative disposal sites for inert C&D Material from Contract 823B include Him Wan EPD Sludge Treatment Plant (EP/SP/58/08) and Wo Shang Wai.
10. Alternative disposal sites for inert C&D Material from Contract 825 include Ha Ko Po Tsuen Residential Development, Fan Kam Road Ku Tung South Residential Development and Sludge Treatment Facility in Tuen Mun.

5.5. Landscape and Visual

5.5.1 Monitoring Requirement

A Certified Arborist was employed and has conducted inspection and audits and found that the tree protection works being carried out by the civil works and transplanting contractors were in accordance with EP/EIA.

Monitoring of the implementation of landscape and visual aspect including the tree protection measures during construction phase was conducted in accordance with the requirements of EP condition 2.15 and Section 5.6 of the EM&A Manual.

5.5.2 Audit Result

Regular monitoring and audit was undertaken in accordance with the requirement of EP condition 2.15 and Section 5.6 of the EM&A Manual.

Tree Transplanting Works at Contract 801

Improvement in health condition of transplanted tree was observed from previous month. Nonetheless, physical damage of transplanted trees was observed. Some of the transplanted trees were infected by pathogen. Detail investigation was being carried out to find out possible cause. In addition, contractor was requested to provide treatment for termites and pest.

Tree Protection Work 802

Construction activities were observed in proximity to tree canopy and the contractor was reminded to improve the tree protection. Wound due to the last pruning was requested to be traced and cleaned.

Tree Protection Work 803A

Contractor was reminded to avoid damage to trees on slope by machine. Tree protection zone was required to be established and reinforced with immovable barriers.

Tree Protection Work 805

Areas underneath retained trees were observed to be used as car parking space. Protective measure should be improved. T8986 have symptom of bark peeling and suffer from canker disease. Pesticide treatment was undertaken with condition of T8986 was improved. It was recommended that the protective fencing for T8887 to be strengthened.

Tree Protection Work 810B

It was observed that pesticide treatment was carried out. Incidence of Thrips declined in this month.

Tree Protection Work 811A

Protective fencing was recommended to be improved which was found to be close to the trees.

Tree Protection Work 811B

Construction materials stored within the tree protection area was removed from the tree protection area. Protective measures of retained tree should be reinforced to ensure the trees are properly protected. Contractor was requested to be cautious when operating machineries near protection zone and the effect of exhaust discharge from adjacent construction equipment.

Tree Protection Work 820

Site hoarding and car park surfacing formed around retained trees. Padding is required to be applied for better tree protection.

Tree Protection Work 821

Some of the trees in contract 821 with extensive decay in trunk and main stem. Contractor is required to apply for tree remove which is being processed. T6611 was removed due to the potential tree failure.

Tree Protection Work 822

The overall tree protection measures is required to be further improved. The contractor is required to follow the recommendations given by EP Arborist for the improvement of tree protection. Remedial action by contractor for potential hazardous tree for T7060 was requested. The retained trees have been transplanted within site and the contractor was required to improve the drainage. Some of the openings was widened in the hoarding to avoid damaging the tree bark.

Tree Protection Work 823A

Tree protection work was commenced. Measures in protecting tree on site should be further improved.

Tree Protection Wok 823B

Tree protection measures were in general adequate to protect the retained tree on site. T14638 and T14639 tree protection measures was undertaken to minimize the impact of sheet piling work.

Tree Protection Work 824

Protective fencing around retained trees should be improved. Storage of heavy construction materials within tree protection zone was found and contractor was reminded to remove the materials.

Tree Protection Work 825

Tree protection fencings for trees need to be improved.

5.6 Cultural Heritage

No monitoring was carried out at ex-Lai Chi Kok Hospital (LCKH) since no construction nearby LCKH in the reporting month.

Construction works between 50m and 100m from Cheung Yuen (LET-06) were conducted in the reporting month. Regular vibration monitoring at 2 monitoring locations were conducted weekly in the reporting month. Calibrated vibration and overpressure monitors, Minimate Plus were used for the vibration monitoring. There was no exceedance of vibration level of 25mm/s for the monitoring on 5, 11, 19 and

28 July 2011 as shown in the table below. Details of the monitoring results and monitoring location plan are attached in Appendix J.

	Peak Vector Sum (mm/s)	
Date	C823B_NB142_VIBR1	C823B_NB142_VIBR2
5 July 2011	0.135	0.154
11 July 2011	0.839	0.212
19 July 2011	0.111	0.658
28 July 2011	0.247	0.357

Table 5-27 Vibration Monitoring result at Cheung Yuen

5.7 Landfill Gas

No monitoring was carried out in this reporting month since there was no construction within the Ngau Tam Mei Landfill (NTML) and Gin Drinker Bays Landfill (GDBL) consultation zone.

6. SITE INSPECTION

Regular site inspections on all environmental aspects under the EM&A Manual were attended by representatives from ET and Contractors. The site inspections were carried out at 802/805 in Nam Cheong, 803A, B, D, 810B and 811A/B in West Kowloon, 820/821 in Nam Cheong, 822 in Shing Mun, Shek Yam and So Kwun Wat, Tsing Chau Tsai and Tai Shu Ha Road West, 823A/B in Shek Kong Stabling Sidings, 824 in Tai Kong Po and Ngau Tam Mei, 825 in Mai Po and Siu Lam Barging Point and dates are shown in the following table. In addition to the regular site inspections attended by ET and Contractors, monthly IEC environmental audits attended by IEC, ET and Contractors were held on 20 July 2011 in 802; 6 July 2011 in 803A; 8 July 2011 in 803B; 6 July 2011 in 803D; 13 July 2011 in 810B; 20 July 2011 in 805; 14 July 2011 in 811A; 26 July 2011 in 811B; 7 July 2011 in 820; 26 July 2011 in 821, 4 July 2011 in 822; 6 July 2011 in 823A; 19 July 2011 in 823B; 12 July 2011 in 824 and 14 July 2011 in 825.

Contract	**Date of Site Inspections**
802	8/7, 13/7, 20/7 and 27/7
803A	6/7, 14/7, 20/7 and 27/7
803B	8/7, 15/7, 22/7 and 29/7
803D	6/7, 14/7, 20/7 and 27/7
810B	6/7, 14/7, 20/7 and 27/7
805	8/7, 13/7, 20/7 and 27/7
811A	14/7, 19/7, and 28/7
811B	12/7, 19/7 and 26/7
820	7/7, 14/7, 21/7 and 28/7
821	8/7, 15/7, 19/7 and 26/7
822	4/7, 11/7, 18/7 and 25/7
823A	6/7, 13/7, 20/7 and 27/7

Contract	Date of Site Inspections
823B	5/7, 12/7, 19/7 and 26/7
824	5/7, 12/7, 19/7 and 26/7
825	4/7, 14/7, 23/7 and 25/7

Table 6-1: Date of site inspection

All observations have been recorded in the audit checklist and passed to the Contractor together with the appropriate recommended mitigation measures where necessary. The key observations from these site inspections and Contractor's follow-up action are summarized in Table 6-2 below. One non-compliance was observed in Contract 824 regarding discharge of muddy water from Tai Kong Po site.

Item	Description	Contractor's Follow-up Action(s) Undertaken
Contract 802		
1	Stockpile of sand was not covered.	The stockpile was covered.
2	Quality of water discharge should be improved	Wastewater treatment plant was maintained properly.
3	Gaps were found between noise barriers.	Noise barriers were erected properly.
Contract 803A		
1	It was observed that many chemical drums were placed outside the storage area at the Maintenance Workshop without proper management.	The contractor was undertaken the action to cover the drums with tarpaulin which were stored on site and the emptied drums have been removed offsite.
2	It was observed that cement bags placed at the grouting machine was not entirely covered well.	The Contractor was reminded to cover the cement bags with impervious sheet when not in use..

Item	Description	Contractor's Follow-up Action(s) Undertaken
3	It was observed that stagnant water was accumulated in front of the first aid room at the works area opposite to Austin Station.	The contractor has cleared the water and filled the ground with soil to avoid recurrence.
Contract 803B		
1	It was observed that the drip tray of generator/air compressor was trapped with stagnant water and to be the potential breeding point of mosquitoes near the works areas along Lin Cheung Road.	The contractor has cleaned the drip tray regularly to reduce the risk of potential mosquito breeding.
2	It was observed that gap was identified between the noise barriers for air compressor at the works areas opposite to Austin Station.	The contractor was provided additional barrier to properly enclose the air compressor to avoid noise nuisance.
3	It was observed that the stockpile on site without proper dust suppression measures near the works areas opposite to Austin Station.	The contractor was reminded the workers to frequently water the stockpile and used as backfilling material asap.
Contract 803D		
1	It was observed that the noise protective measures at the hydraulic breaker head was not in good condition near the works areas opposite to Elements.	The contractor has replaced the noise protection materials accordingly.
2	It was observed that the perforated hole of drip tray of generator was not properly plugged at the works area next to the barging facilities.	As the project has substantially completed, the contractor removed the generator offsite.

Item	Description	Contractor's Follow-up Action(s) Undertaken
Contract 805		
1	The air compressor was not provided with any leakage control measure.	Drip tray was provided for the air compressor.
2	The drainage channel was filled with mud / spoil, which could cause overflow of construction runoff to public area during heavy rainfall.	Sand bags and cement were placed on the edge of hoarding to prevent the loose material and spoil on the slope from sliding down to the drainage channel.
3	The water quality of discharge apparently was not satisfactory.	Sedimentation tank with improved capacity and effectiveness for water treatment will be provided.
Contract 810B		
1	It was observed that insufficient noise mitigation measures were applied to the equipments or machines at the works areas along Lin Cheung Road.	Noise protective measures by the means of acoustic mat have been deployed by the contractor and its subcontractors at the equipments used on site accordingly.
2	It was observed that insufficient air quality control measures was implemented on site in general (mainly the excavation zone).	The contractor stated that apart from the employed water tanker, the exposed works areas has been kept water spraying by the workers and sprinklers have been installed along the access road from barging point to the site entrance.
3	It was observed that sandbags placed at the hoarding skirt at the works areas opposite to Elements and along the shore edge of barging facilities was broken.	The contractor has replaced the sandbags in order to minimize the potential problem of water spilled out.
4	It was observed that temporary drainage channel under the temporary road bridge was full of sediment and stagnant water along the works areas at Austin Road West.	The contractor has removed the stagnant water and filled the ground with sand. The sediment has been cleared as well and disposed of in accordance with the waste disposal procedures accordingly.

Item	Description	Contractor's Follow-up Action(s) Undertaken
Contract 811A		
1	Chemical containers were found not properly stored on site	Drip trays were provided for the chemical storage area.
2	No drip tray provided for some generators/air compressors	Drip trays were provided for the subject construction plants
Contract 811B		
1	Dark smoke was observed for a few air compressors	The plants were fixed by replacing the filters
2	Leakage of oil was observed for some construction plants	The plants were fixed and the soil with oil stain was cleaned up
3	Drip trays for generators/chemical containers were not properly maintained	Drip trays have been cleaned up.
Contract 820		
1	Chemical was observed storing on bared ground.	Drip tray was provided.
2	Potential surface runoff to the u-channel in FMO(B) was observed.	Sand bags bund was construction along the u-channel.
3	Stockpile of dusty material without covering was observed in Nam Cheong Barging Point.	The stockpile was covered.
Contract 821		
1	Water pump for sedimentation tank in Nam Cheong Barging Point was not operating.	The water pump was fixed to operate.
2	Insufficient mitigation measures for dust suppression for stockpile area in Kwai Chung Ventilation Building area.	Sprinkler system was installed for dust suppression.
Contract 822		

Item	Description	Contractor's Follow-up Action(s) Undertaken
1.	The chemical drum was not provided with any leakage control measure at Pat Heung and Shing Mun.	Drip trays have been provided immediately.
2	The stockpile of excavated material was not fully covered at Pat Heung.	The stockpile has been covered by tarpaulin entirely.
3	The drilling operation generated excessive amount of dust and dark smoke at Shing Mun.	Apart from the dust sheeting, manual water spraying will be added when excessive dust appears.
Contract 823A		
1	Chemical was observed without drip tray at Nam Hing West Road Site near the silos	Drip tray was provided to avoid contamination in case of leakage
2	Uncovered stockpile was observed at Tse Uk Tsuen	Stockpile was covered properly
3	Noisy activity was observed at Tsat Sing Kong Works Area without noise mitigation measure	Noise mitigation measure was provided
Contract 823B		
1	Oil stain was observed on ground at north-zone of Shek Kong works area.	The contaminated soil was cleared and treated as chemical waste.
2	Soil/mud was observed at the u-channel near several works area at SSS	Silt and mud in u-channel was cleared regularly.
3	Insufficient wastewater treatment facility was identified in mid-zone of Shek Kong works area.	Additional sedimentation tank was provided to improve wastewater treatment performance.
Contract 824		
1	Muddy wastewater was found discharging from Tai Kong Po site	Bund was constructed to divert the surface runoff from outside of the site to avoid generation of muddy water

Item	Description	Contractor's Follow-up Action(s) Undertaken
2	Un-covered stockpile was observed at Tai Kong Po site	The stockpile was covered to avoid dust impact and generation of muddy water
Contract 825		
1	Inactive stockpiles were found uncovered at Mai Po Works Area	The stockpile was covered.

Table 6-2 Summary of site inspections, recommendations and follow-up actions

Regarding the IEC audit findings on 822 Pat Heung Ventilation Building Works Area, please refer to the Appendix K.

7. NON-COMPLIANCE AND DEFICIENCY

7.1 Summary of Complaint

For this reporting month, a total of 3 environmental complaints were referred from EPD. There are a total of 55 environmental complaints since commencement of the construction. The complaints were handled in accordance to the EM&A Manual and relevant parties including the Engineer's Representative and IEC were informed of the complaints. The details of complaint are summarized as below:

A complaint was referred from EPD on 5 July 2011 about the night time construction noise generated from tunneling work near Sheung Kwai Chung Tsuen . The complaint handling procedures in accordance with the EM&A Manual has been undertaken. It was investigated the contractor had valid construction permit for working of powered mechanical equipment. In addition, the rock breaking activity had been scheduled outside sensitive hours between 23:00 and 07:00 of following day. Nevertheless, the contractor was reminded to follow the condition as stipulated in the CNP.

A complaint was referred from EPD on 18 July 2011 about dark smoke and malodour from the XRL construction site near The Waterfront. The complaint handling procedures in accordance with the EM&A Manual has been undertaken. Site inspection had been conducted and found that no substantial dark smoke was emitted from the powered mechanical plants and the malodour was suspected from the mobile toilet. The Contractor enhanced the site management and provide sufficient control.

A complaint was referred from EPD on 26 July 2011 about the daytime and night time construction noise from 820 at Hoi Wang Road area. The complaint handling procedures in accordance with the EM&A Manual has been undertaken. It was investigated that no construction works with PME after 7pm of normal working days was conducted by the Contractor. For daytime construction noise, it might be caused by grouting works by 820 Contractor at Hoi Wang Road area. Further noise mitigation measure had been proposed and implemented on site.

7.2 Summary of Exceedance

In the reporting month, noise exceedances of air-borne noise Limit Level were recorded at Wang Toi Shan (CN 8) on 14 Jul 2011; No. 305B - Sheung Tsuen San Tsuen Village House (CN 15) on 18 Jul 2011, HKIVE Haking Wong Waterfront Annex (CN 23) on 6 and 20 Jul 2011; Sorrento (CN 31) on 26 Jul 2011; The Waterfront (CN 32) on 6, 14, 21 and 28 Jul 2011 and The Arch (CN 33) on 26 Jul 2011.

For the noise exceedance at CN 8, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. Upon investigation, the exceedance might possible be due to the drilling works by 823A Contractor. The Contractor was requested to provide noise mitigation measures to minimize the noise impact.

For the noise exceedance at CN 15, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. Upon investigation, the exceedance were mainly caused by the renovation work of the village house naerby.

Regarding the noise exceedances at CN 23, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. The noise exceedance was caused by the demolition work and pile removal work by 805 contractors. Noise mitigation measure had been implemented for noise suppression.

For the noise exceedance at CN 31 at Sorrento, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractor were informed of the exceedance. Upon investigation, the exceedance may possibly caused by the construction works of 811B and the roadworks activities under 810B carried out at the nearby work site and noise mitigation measures have been enhanced to avoid further noise exceedance.

For the noise exceedances at The Waterfront (CN 32) and The Arch (CN 33) in West Kowloon, actions identified in the Event and Action Plan (Table 3.4 of the EM&A Manual) were undertaken. The ER, IEC and Contractors were informed of

the exceedances. The investigation result revealed that noise source may possibly due to works by 803A, 803B, 803D and 810B Contractors. Additional noise mitigation measures proposed by the Contractor were reviewed by IEC and ET and implemented by the 803A, 803B, 803D and 810B Contractors to minimize the noise impact. All contractors in WKT works area were reminded to enhance the noise mitigation measures to comply with the statutory requirement and minimize noise nuisance to the nearby NSRs.

In addition, there was one noise exceedance of Action Level triggered due to noise complaint during daytime hours received in the reporting month. Please refer to Section 7.1 above for details.

In the reporting month, there was no exceedance of 24-hr TSP Action and Limit Level.

7.3 Summary of Notification of Summons, Prosecutions, Non-compliance and Corrective Actions

In the reporting period, a non-compliance was issued to 824 Contractor on 13 July 2011 for discharging of muddy water from Tai Kong Po Works Area. EPD was informed of the incident according to the EP condition. After investigation, the cause of incident was due to inflow of surface runoff from outside of the site. A bund was constructed as mitigation measure to divert the surface run-off from entering the construction site. Subsequent joint inspections were carried out with joint participation by EPD, IEC, ET, ER and Contractor to assess the effectiveness of the mitigation measure. The situation would be closely monitored by IEC and ET.

8. FUTURE KEY ISSUES

8.1 Construction Works in Coming Months

Works to be undertaken for the following months are summarized below. The works presented below is tentative and subject to change in actual construction programme.

Contract 802 (Works Area Q)
Sheet-pilling, bored pile removal, utility diversion, H-pile extraction, pile cap demolition and excavation & lateral supports
Contract 803A (Works Area V1)
Remedial works, concrete coring and backfilling of core holes
Contract 803B (Works Area V1)
Bored piling works, Interface Coring for Bored Piles, Loading test and Socketted H-piling works
Contract 803D (Works Area V1)
Loading test, remedial works and concrete coring.
Contract 805 (Works Area N & O)
Piers removal of footbridge, sheet piling works, cap demolition, and pile removal,
Contract 805 (Works Area S)
Pile removal
Contract 810B (Works Area V1)
Bore piling, Pre-drilling, Excavation, Foundation work and Construction of temporary traffic deck
Contract 810B (Works Area V1 & W)
Installing Conveyor System of Barging Facilities

Contract 811A (Works Area V2)
Pumping Test, excavation works, traffic diversion at Lai Cheung Road; external works to CLP Sub Station at Lai Cheung Road
Contract 811B (Works Area V2 & Y)
Construction for diaphragm wall, bored piling and H-piles, temporary road construction, construction and demolition of footbridge; culvert diversion; operation of Nam Cheong Barging Point
Contract 820 (Works Area L)
Nil
Contract 820 (Works Area M)
Sheet pile installation and pile cap construction;Grout treatment.
Contract 820 (Works Area P)
Excavation in Zone A and Zone B on going, concurrent with installation of strutting layers; Install FS1 supporting system and lagging wall. Pumping test stage 2 on Box B; Removal of piles for FMO Pier A and rising main
Contract 820 (Works Area Q)
Removal of piles
Contract 820 (Works Area R)
Re-design of cofferdam for pile removal
Contract 820 (Works Area S)
Diversion of gas main, and water main.
Contract 820 (Works Area Y)
Barging Point site setup
Contract 820 (Works Area V2)
Ground treatment works
Contract 821 (Works Area J)

Pipe work for the water-recycling and treatment system, set up of maintenance workshop, blasting, breaking & drilling work at the portal.
Contract 821 (Works Area Y)
Operation of the barging point
Contract 822 (Works Area F)
Construction inside tunnel adit
Contract 822 (Works Area G)
Construction of pipe pile wall
Contract 822 (Works Area H)
Main tunnel construction, conveyor installation
Contract 822 (Works Area AC)
Nil
Contract 822 (Works Area AE)
Nil
Contract 822 (Works Area AG)
Nil
Contract 823A (Works Areas D and D1)
Site formation, pre-drilling works
Contract 823A (Works Area E)
Guide wall construction and setup of silo
Contract 823B (Works Areas D)
Site formation, pre-drilling works, east and west culvert construction, guide wall construction
Contract 823B (To Kau Wan Works Areas)
Nil

Contract 823B (Works Areas Z)
Barging facility set up
Contract 824 (Works Area B)
Bored piling works, retaining wall formation works, drainage works
Contract 824 (Works Area C)
Pipe piling works and grouting at Tai Kong Po Works Area
Contract 824 (Works Area AF)
Nil
Contract 825 (Works Area A)
TBM driving
Contract 825 (Works Area AA)
Nil

Table 8-1 Summary of construction works in coming months

According to the latest programme, no construction would be commenced at new works area in coming month. Impact monitoring would be continued according to the construction programme.

8.2 Monitoring Schedule for Next Month

The tentative schedule of TSP, noise and ecological monitoring for the next reporting period is presented in Appendix E.

9. CONCLUSIONS

The Report presents the results of EM&A works and the impact monitoring for the construction works of the XRL project undertaken during the period of 1 July 2011 to 31 July 2011. The major construction activities in the reporting period included foundation works in the West Kowloon Works Areas, Nam Cheong, Kwai Chung, Shing Mun, Shek Yam, Pat Heung, Tai Kong Po, Ngau Tam Mei, Mai Po Works Area and Barging Points.


Impact monitoring for air quality and noise were conducted in accordance with the EM&A Manual in the reporting period. Exceedances of Limit Level in noise monitoring were recorded at Wang Toi Shan (CN 8) on 14 Jul 2011; No. 305B - Sheung Tsuen San Tsuen Village House (CN 15) on 18 Jul 2011, HKIVE Haking Wong Waterfront Annex (CN 23) on 6 and 20 Jul 2011; Sorrento (CN 31) on 26 Jul 2011; The Waterfront (CN 32) on 6, 14, 21 and 28 Jul 2011 and The Arch (CN 33) on 26 Jul 2011. There was one Action Level exceedance in noise monitoring in the reporting month. There was no exceedance of 24-hour TSP Action and Limit Level was recorded in the reporting month. A non-compliance was issued to Contractor 824 for discharging of muddy water from Tai Kong Po Works Area. Corresponding mitigation measure was implemented by the Contractor and assessed by various project parties.


Three environmental complaints were received in the reporting period. The environmental complaints received were related to construction noise from Shek Yam Tunnel; construction noise from grouting works in Hoi Wang Road and dark smoke and malodour at the works area near the Waterfront. The complaint had been handled in accordance with the procedures stipulated in the EM&A Manual. Investigations were carried out in accordance with the EM&A Manual.


Site inspections were conducted regularly to monitor proper implementation of environmental pollution control and mitigation measures for the Project. The ET would continue the implementation of the environmental monitoring and audit programme in accordance to the EM&A Manual and to a level consistent with MTRCL's Corporate Sustainability Policy.


Appendix A


Works Area

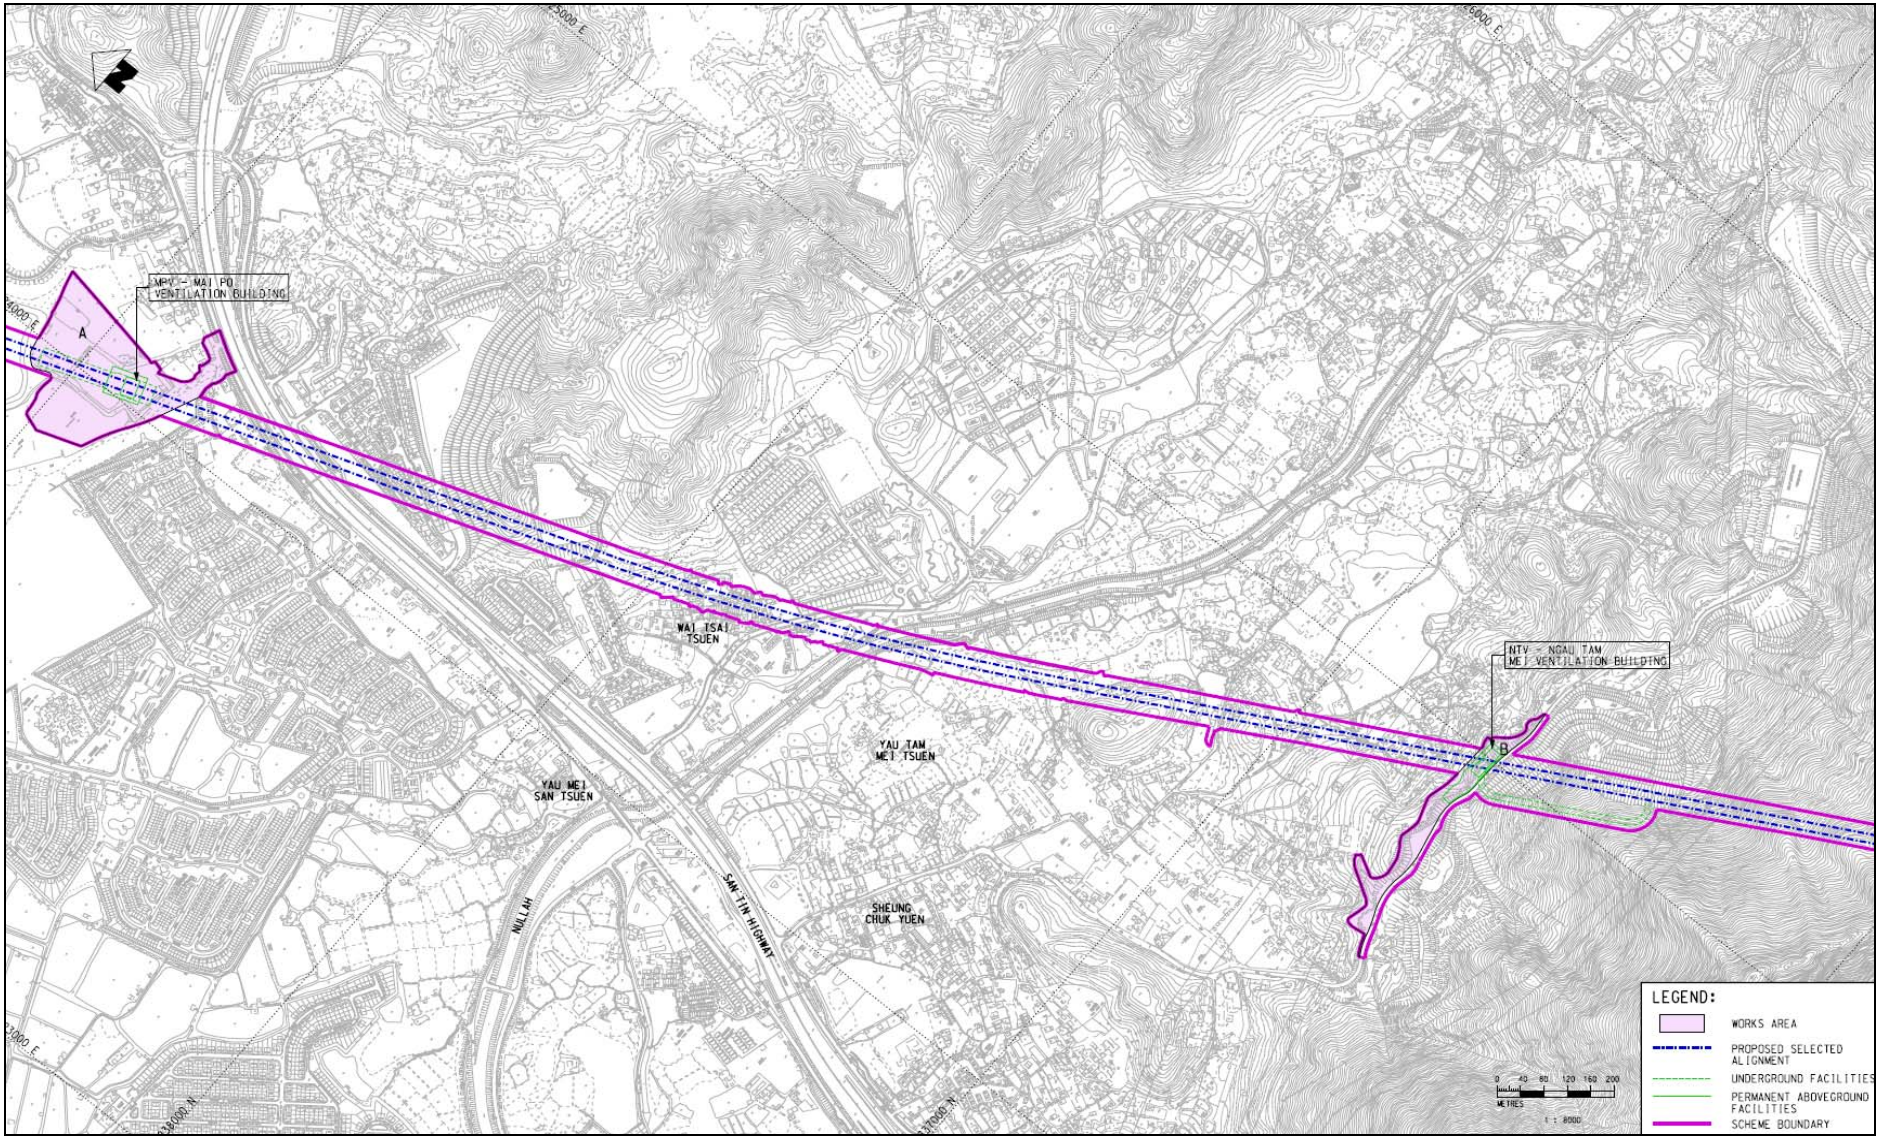

MPV - MAI PO VENTILATION BUILDING
A
NTV - NGAU TAM MEI VENTILATION BUILDING
B
WAI TSAI TSUEN
YAU TAM MEI TSUEN
YAU MEI SAN TSUEN
SHEUNG CHUK YUEN
NULLAH
SAN TIN HIGHWAY
LEGEND:
WORKS AREA
PROPOSED SELECTED ALIGNMENT
UNDERGROUND FACILITIES
PERMANENT ABOVEGROUND FACILITIES
SCHEME BOUNDARY
METRES
1 : 8000

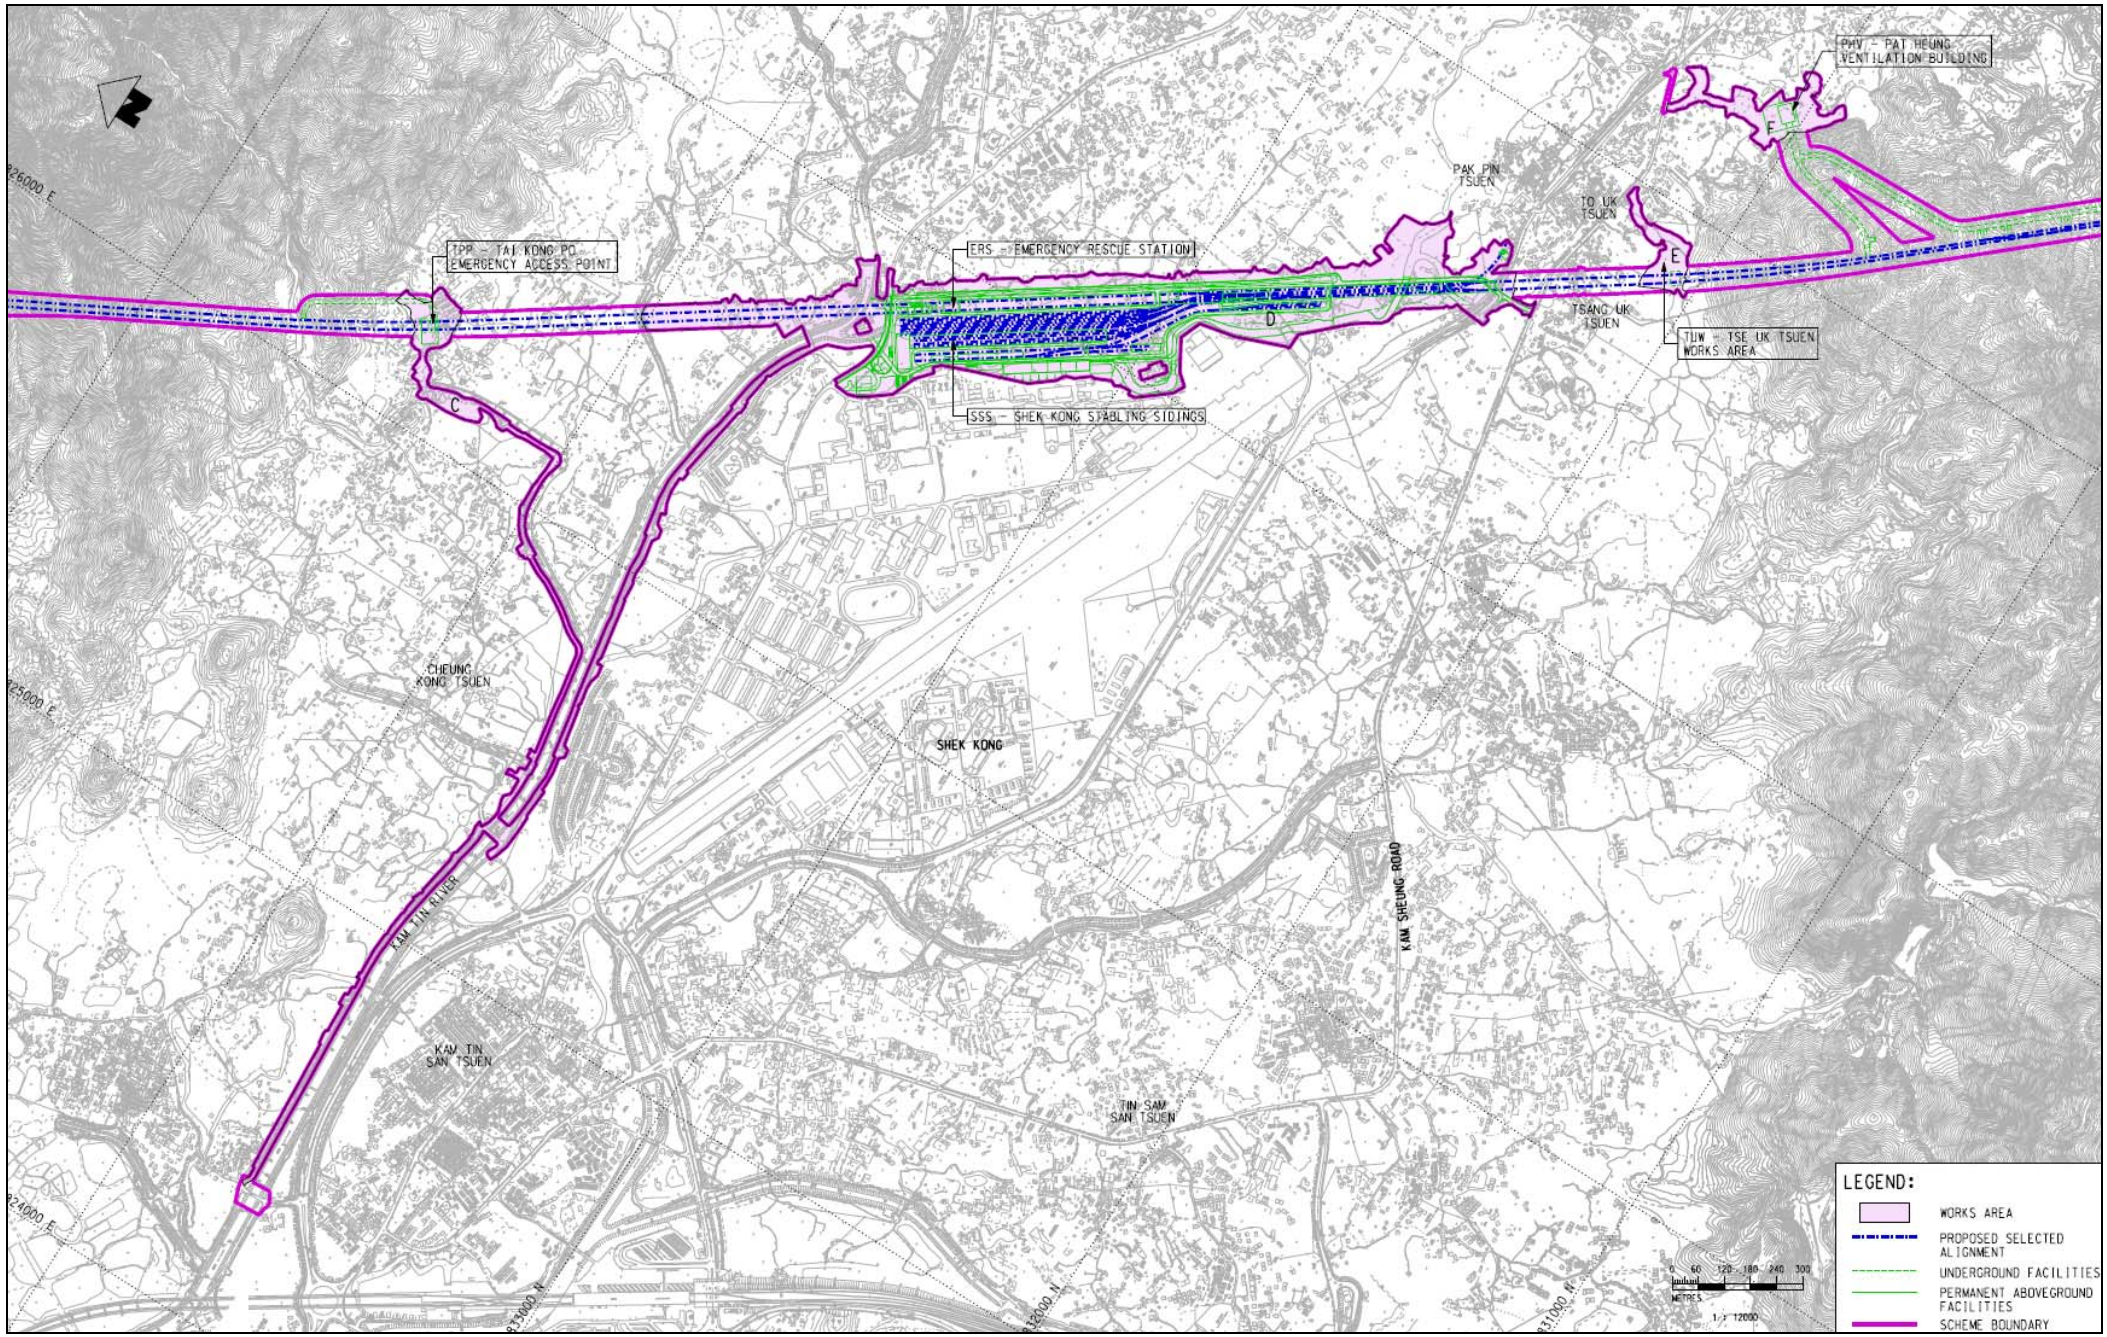

PHV – PAT HEUNG VENTILATION BUILDING
PAK PIN TSUEN
TO UK TSUEN
TSANG UK TSUEN
TUW – TSE UK TSUEN WORKS AREA
TPP – TAI KONG PO EMERGENCY ACCESS POINT
ERS – EMERGENCY RESCUE STATION
SSS – SHEK KONG STABLING SIDINGS
CHEUNG KONG TSUEN
SHEK KONG
KAM TIN RIVER
KAM SHEUNG ROAD
KAU TIN SAN TSUEN
TIN SAM SAN TSUEN
C
D
E
F
826000 E
825000 E
824000 E
833000 N
832000 N
831000 N
0 60 120 180 240 300
METRES
1 : 12000
LEGEND:
WORKS AREA
PROPOSED SELECTED ALIGNMENT
UNDERGROUND FACILITIES
PERMANENT ABOVEGROUND FACILITIES
SCHEME BOUNDARY

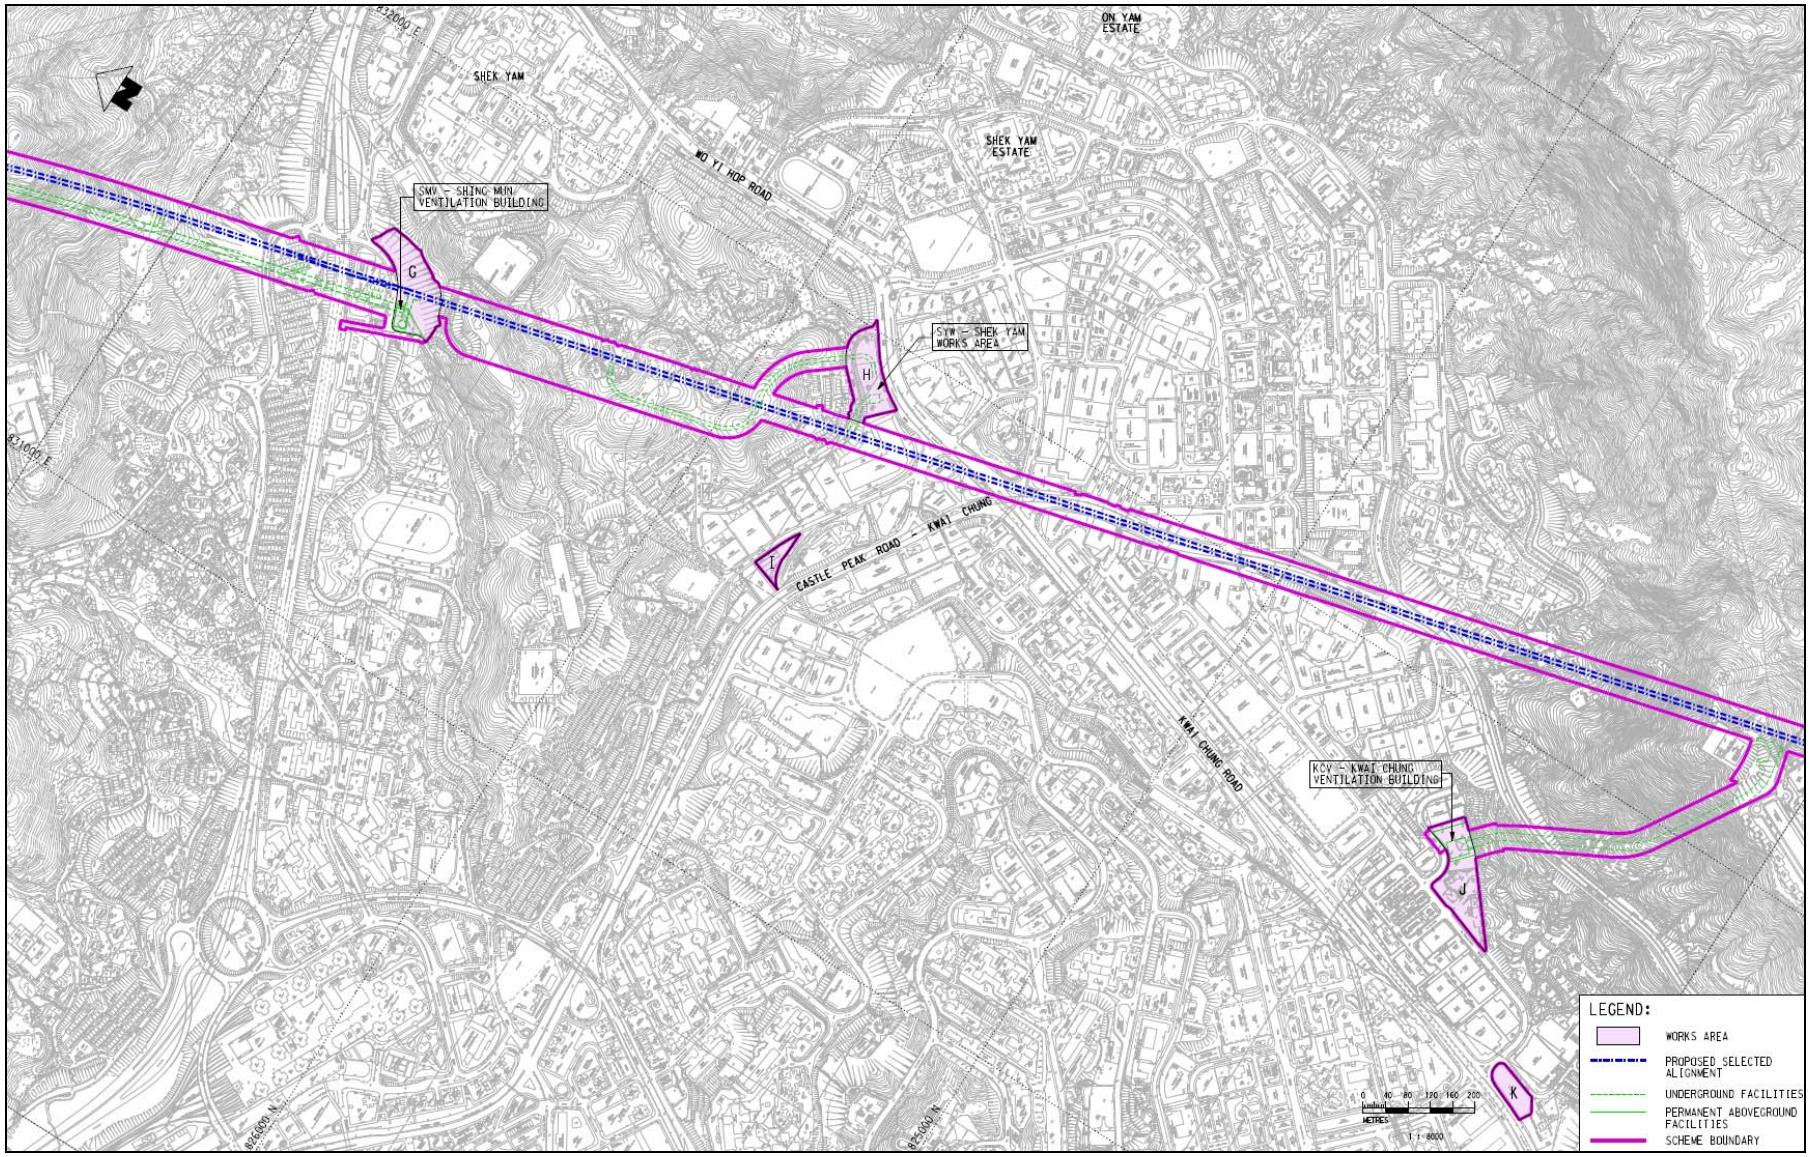

SHEK YAM
ON YAM ESTATE
SHEK YAM ESTATE
WO YI HOP ROAD
SMV - SHING MUN VENTILATION BUILDING
SYW - SHEK YAM WORKS AREA
CASTLE PEAK ROAD - KWAI CHUNG
KWAI CHUNG ROAD
KCV - KWAI CHUNG VENTILATION BUILDING
G
H
I
J
K
831000 E
832000 E
826000 N
825000 N
0 40 80 120 160 200
METRES
1 : 8000
LEGEND:
WORKS AREA
PROPOSED SELECTED ALIGNMENT
UNDERGROUND FACILITIES
PERMANENT ABOVEGROUND FACILITIES
SCHEME BOUNDARY

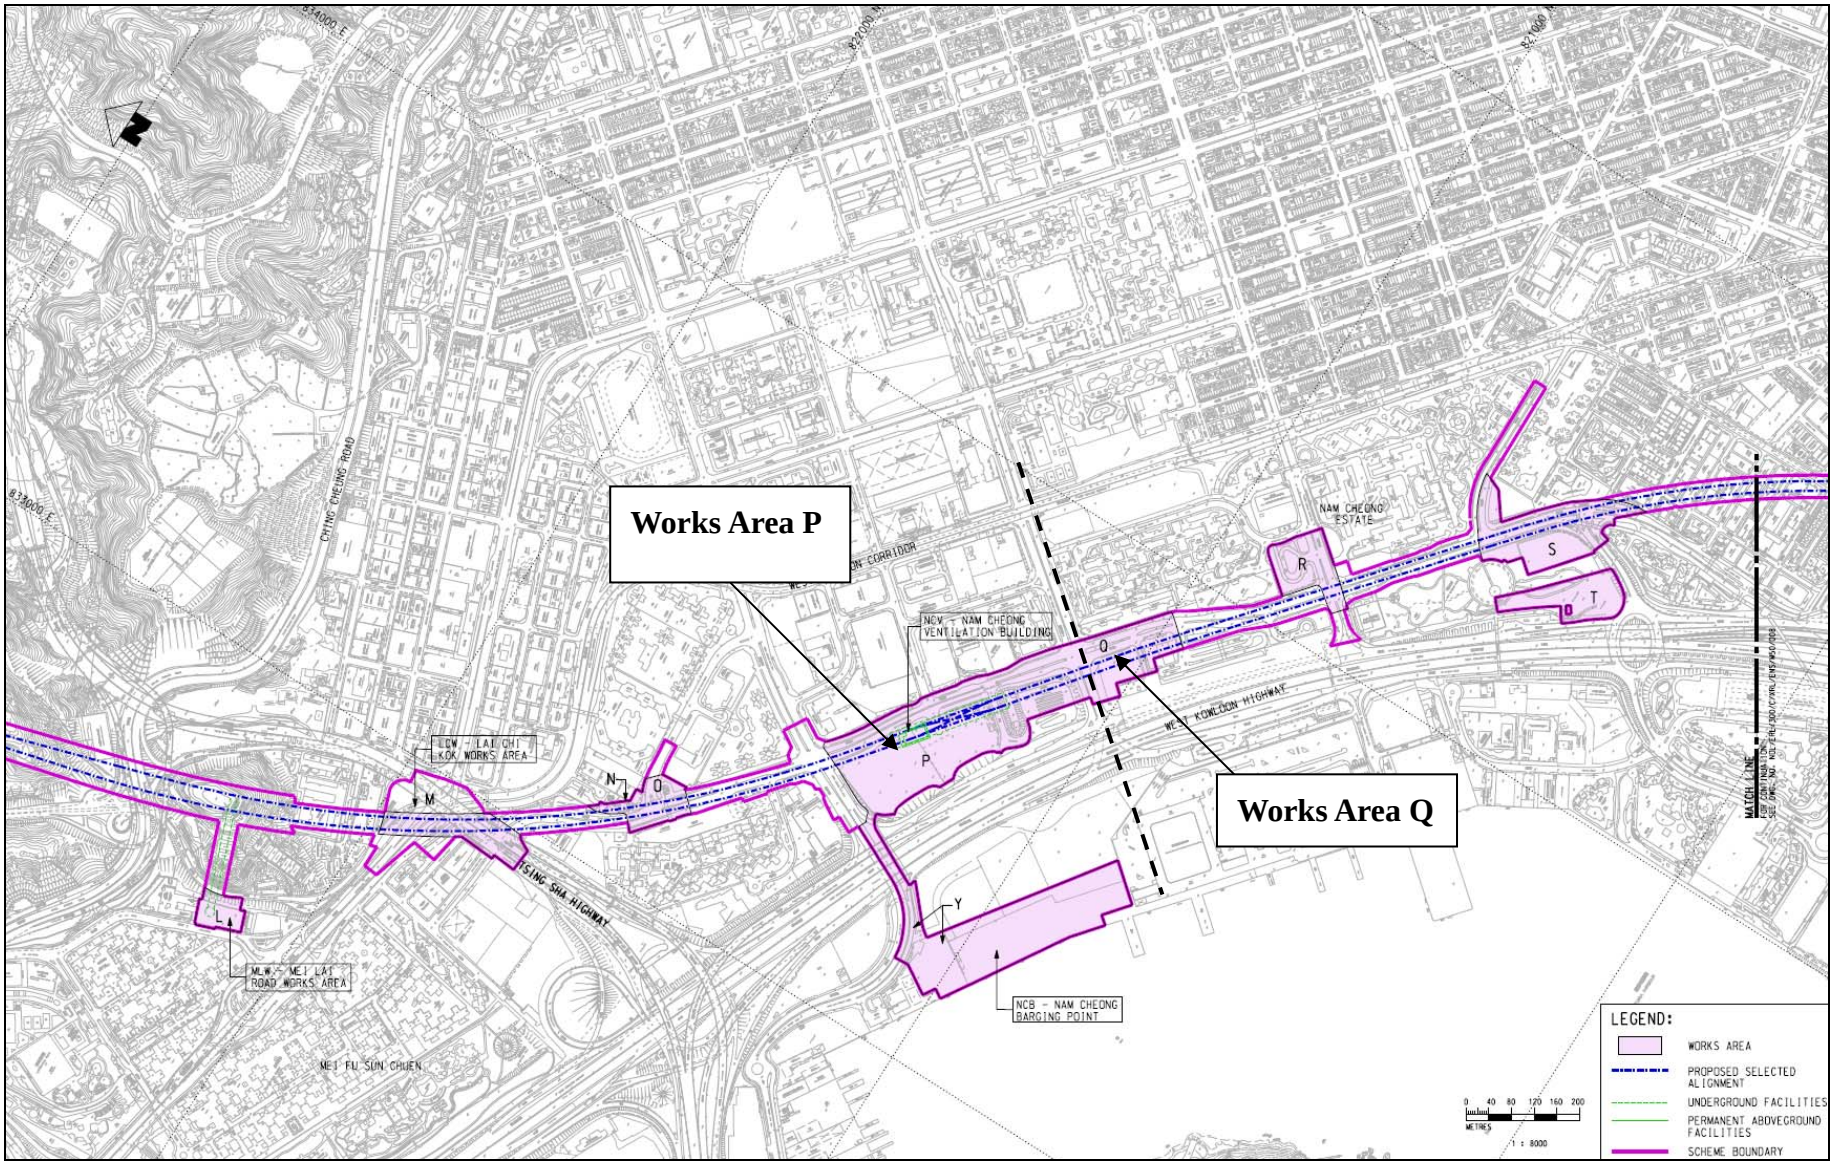
Works Area P
Works Area Q
CHING CHEUNG ROAD
NAM CHEONG ESTATE
NCV - NAM CHEONG VENTILATION BUILDING
WEST KOWLOON HIGHWAY
LCW - LAI CHI KOK WORKS AREA
TSING SHA HIGHWAY
MLW - MEI LAI ROAD WORKS AREA
NCB - NAM CHEONG BARGING POINT
MEI FU SUN CHUEN
MATCH LINE
LEGEND:
WORKS AREA
PROPOSED SELECTED ALIGNMENT
UNDERGROUND FACILITIES
PERMANENT ABOVEGROUND FACILITIES
SCHEME BOUNDARY

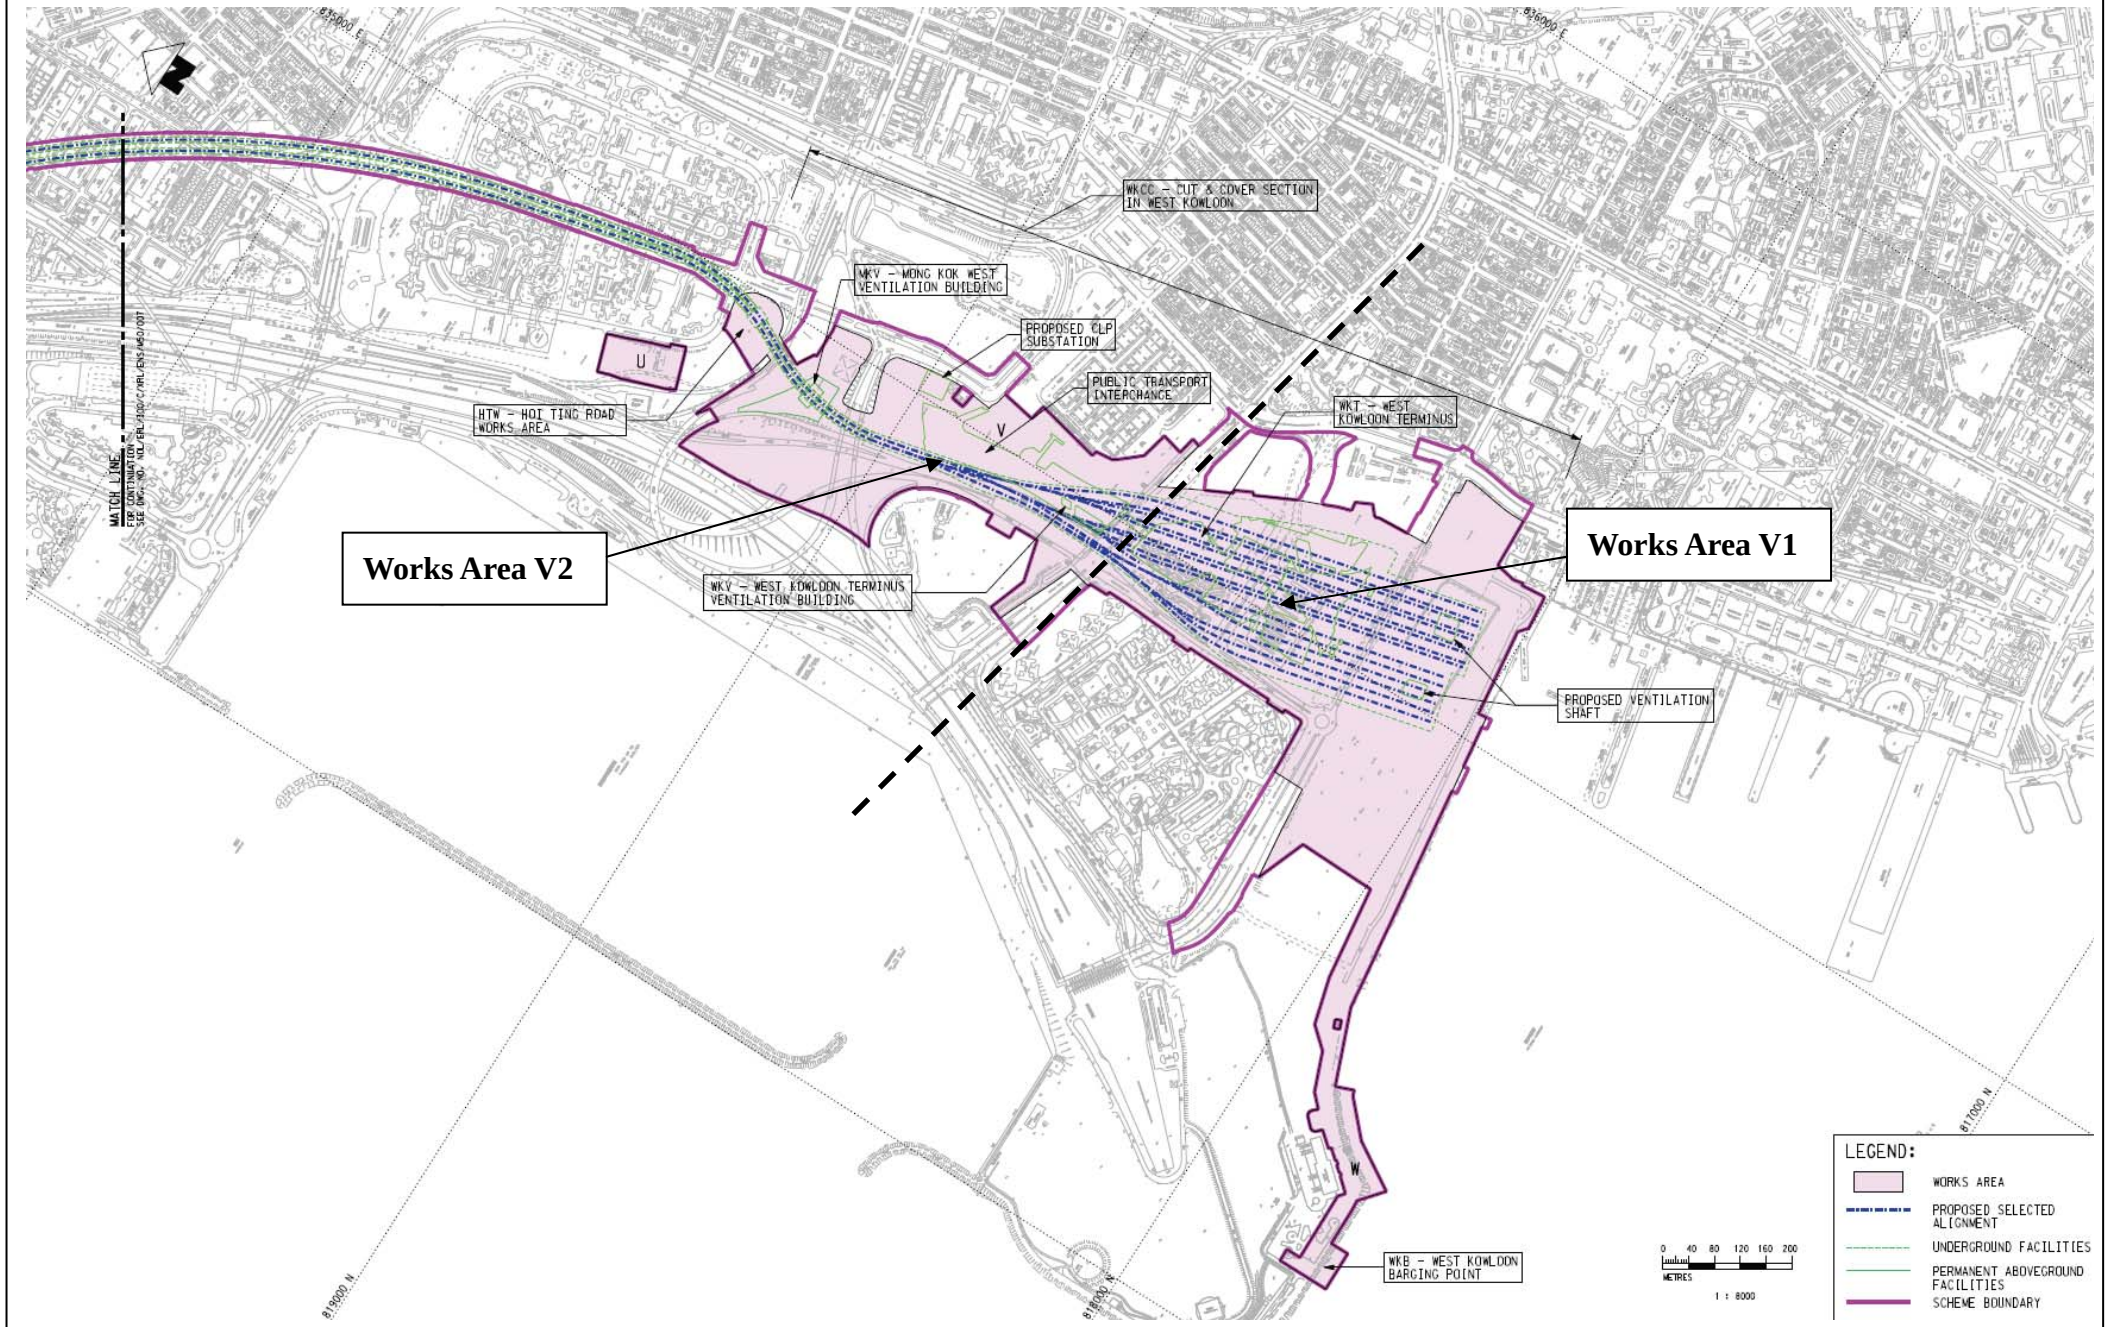

WKCC - CUT & COVER SECTION IN WEST KOWLOON
WKV - MONG KOK WEST VENTILATION BUILDING
PROPOSED CLP SUBSTATION
PUBLIC TRANSPORT INTERCHANGE
WKT - WEST KOWLOON TERMINUS
HTW - HOI TING ROAD WORKS AREA
MATCH LINE FOR CONTINUATION SEE DWG. NO. MEL/800/CIVIL/EKS/WSO/001
Works Area V2
Works Area V1
WKV - WEST KOWLOON TERMINUS VENTILATION BUILDING
PROPOSED VENTILATION SHAFT
WKB - WEST KOWLOON BARGING POINT
U
V
W
836000 E
818000 N
LEGEND:
WORKS AREA
PROPOSED SELECTED ALIGNMENT
UNDERGROUND FACILITIES
PERMANENT ABOVEGROUND FACILITIES
SCHEME BOUNDARY
0 40 80 120 160 200
METRES
1 : 8000

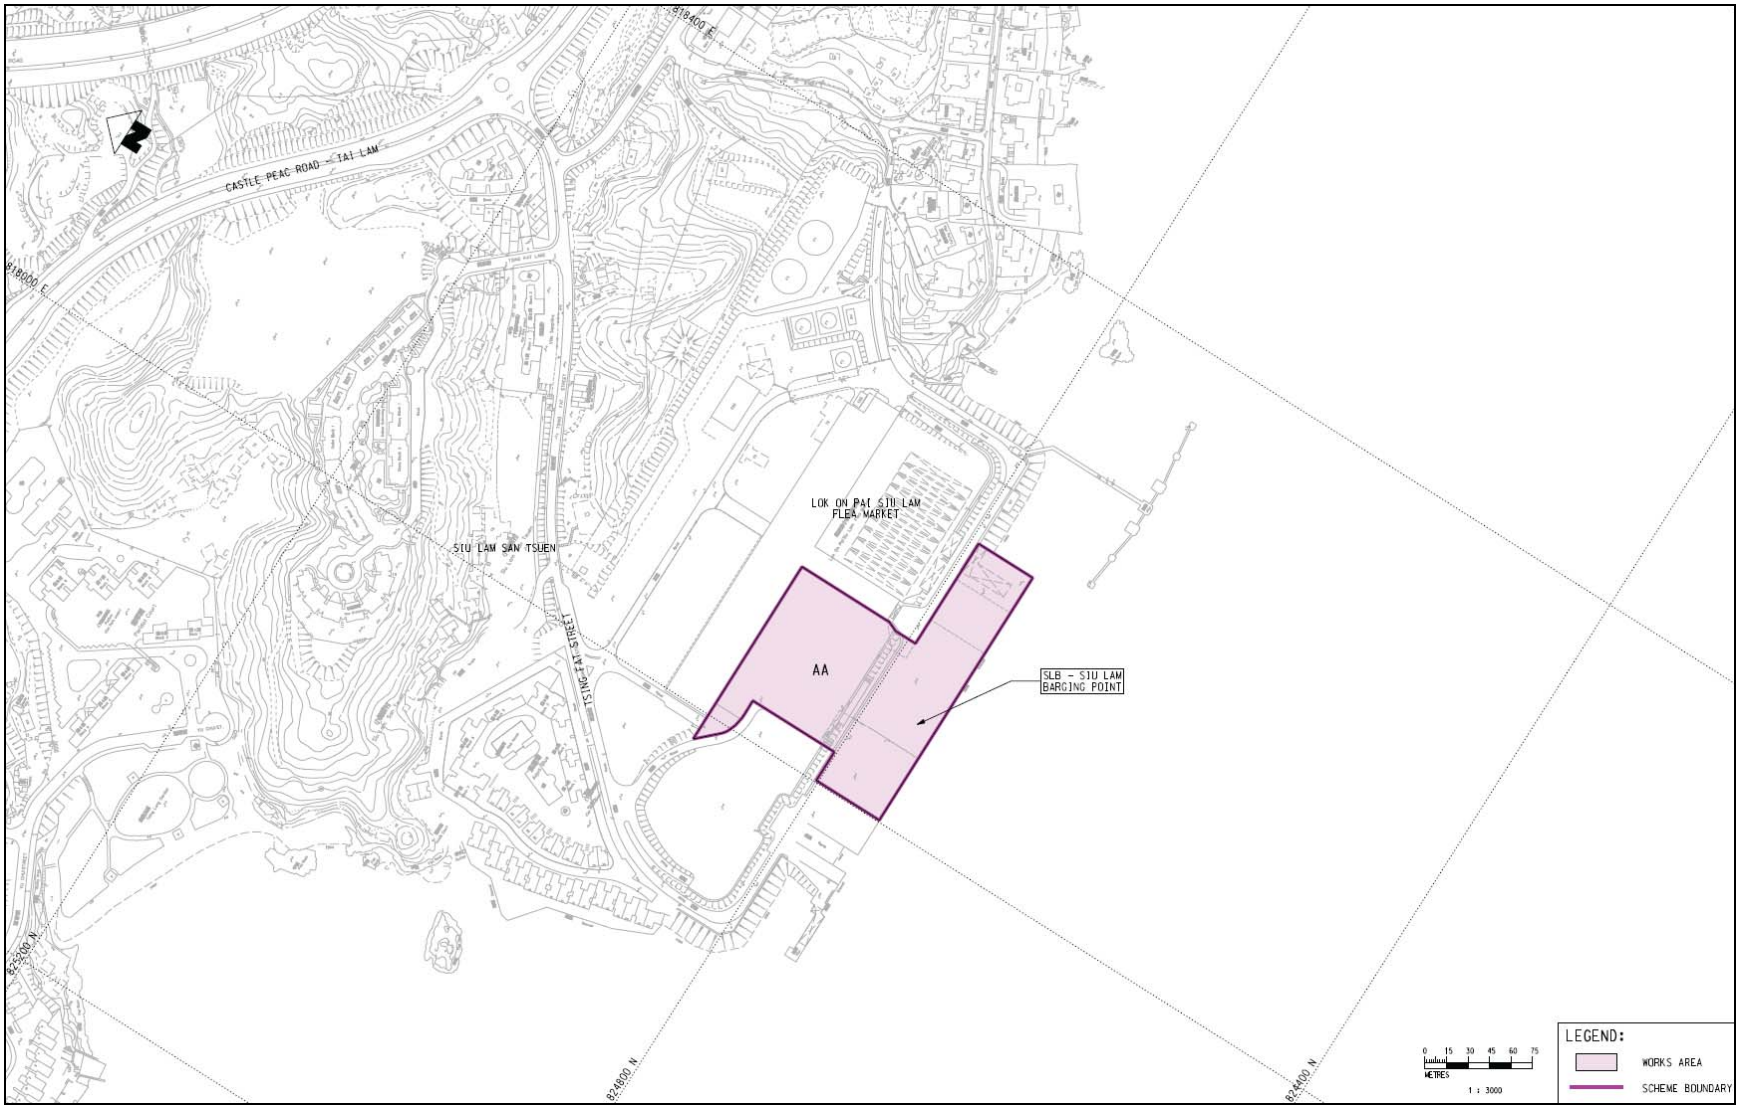
818400 E
CASTLE PEAK ROAD - TAI LAM
818000 E
LOK ON PAI SIU LAM
FLEA MARKET
SIU LAM SAN TSUEN
TSING FAT STREET
AA
SLB - SIU LAM
BARGING POINT
825000 N
824800 N
824400 N
0 15 30 45 60 75
METRES
1 : 3000
LEGEND:
WORKS AREA
SCHEME BOUNDARY

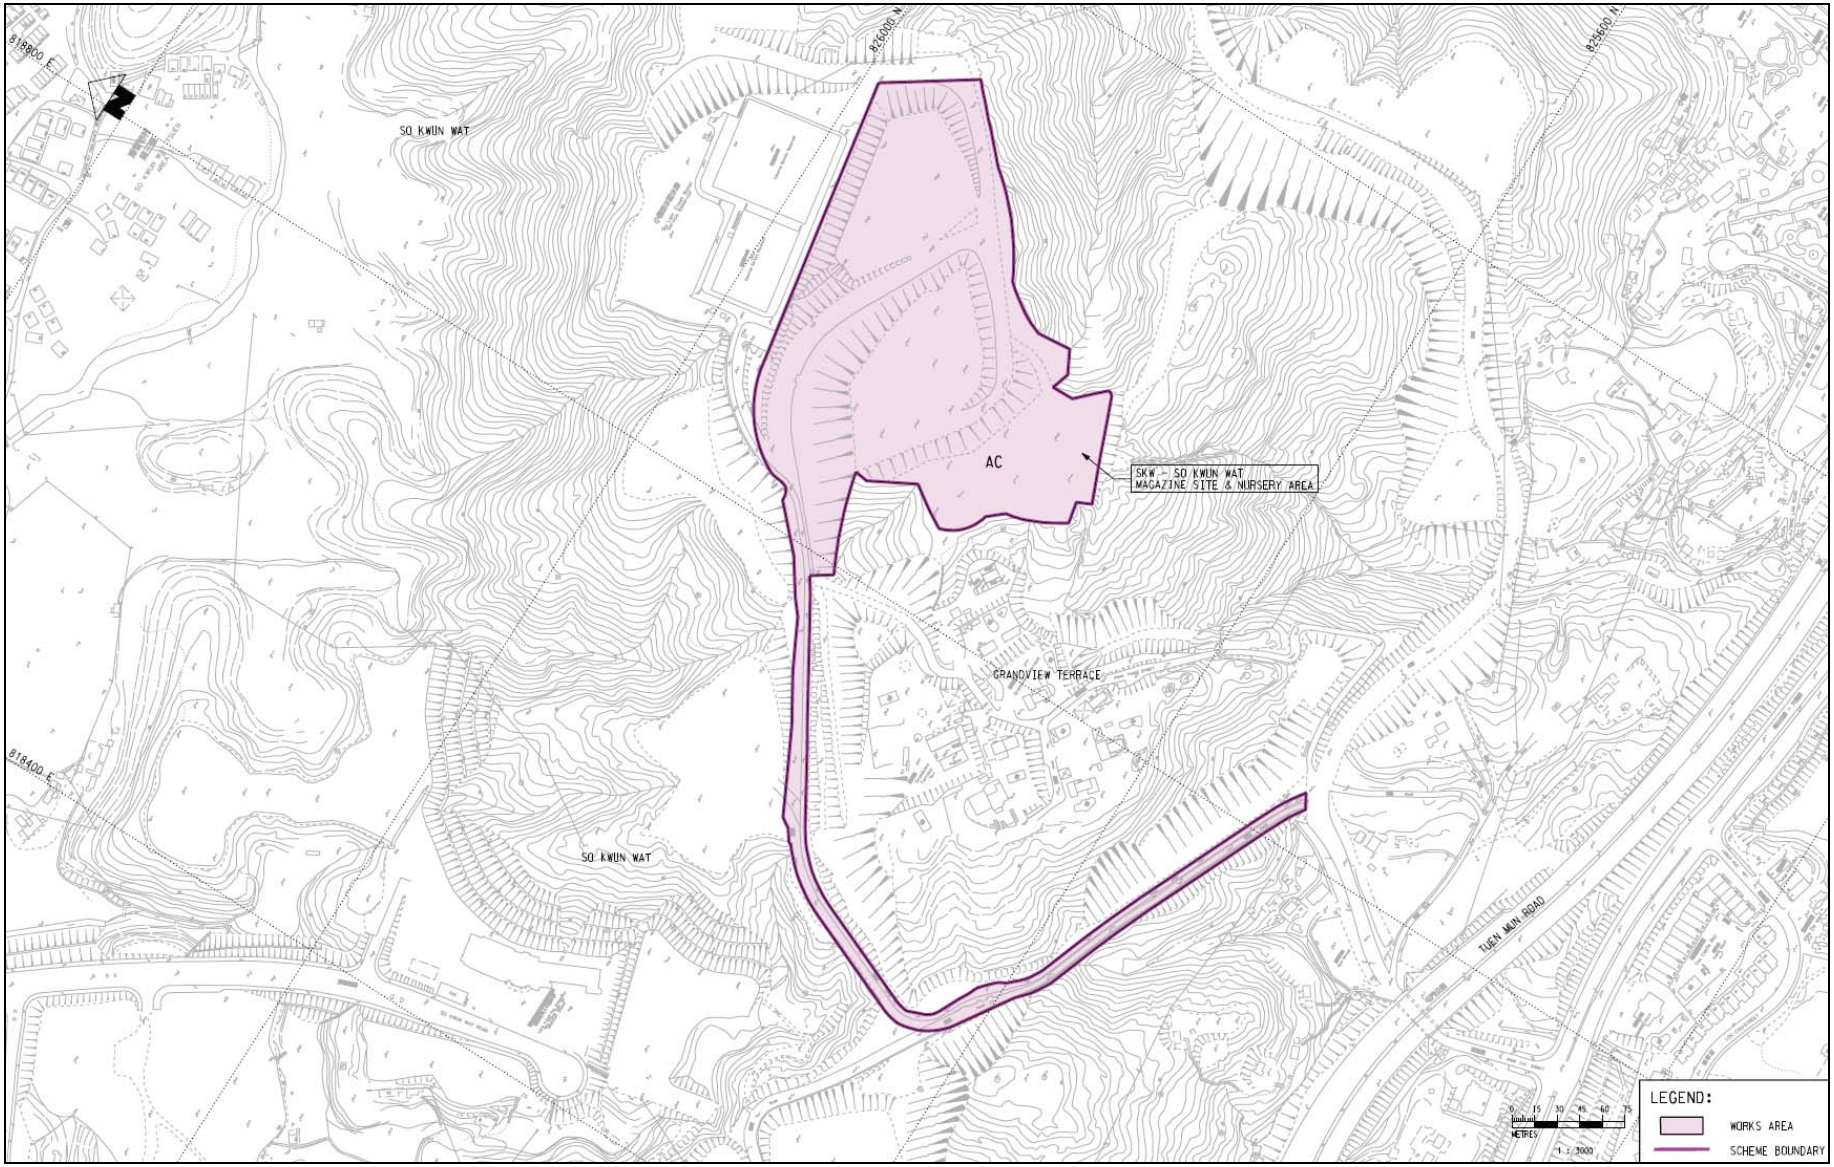
818800 E
818400 E
836600 N
836200 N
SO KWUN WAT
SO KWUN WAT
SO KWUN WAT
AC
SKW - SO KWUN WAT
MAGAZINE SITE & NURSERY AREA
GRANDVIEW TERRACE
TUEN MUN ROAD
0 15 30 45 60 75
METRES
1 : 3000
LEGEND:
WORKS AREA
SCHEME BOUNDARY

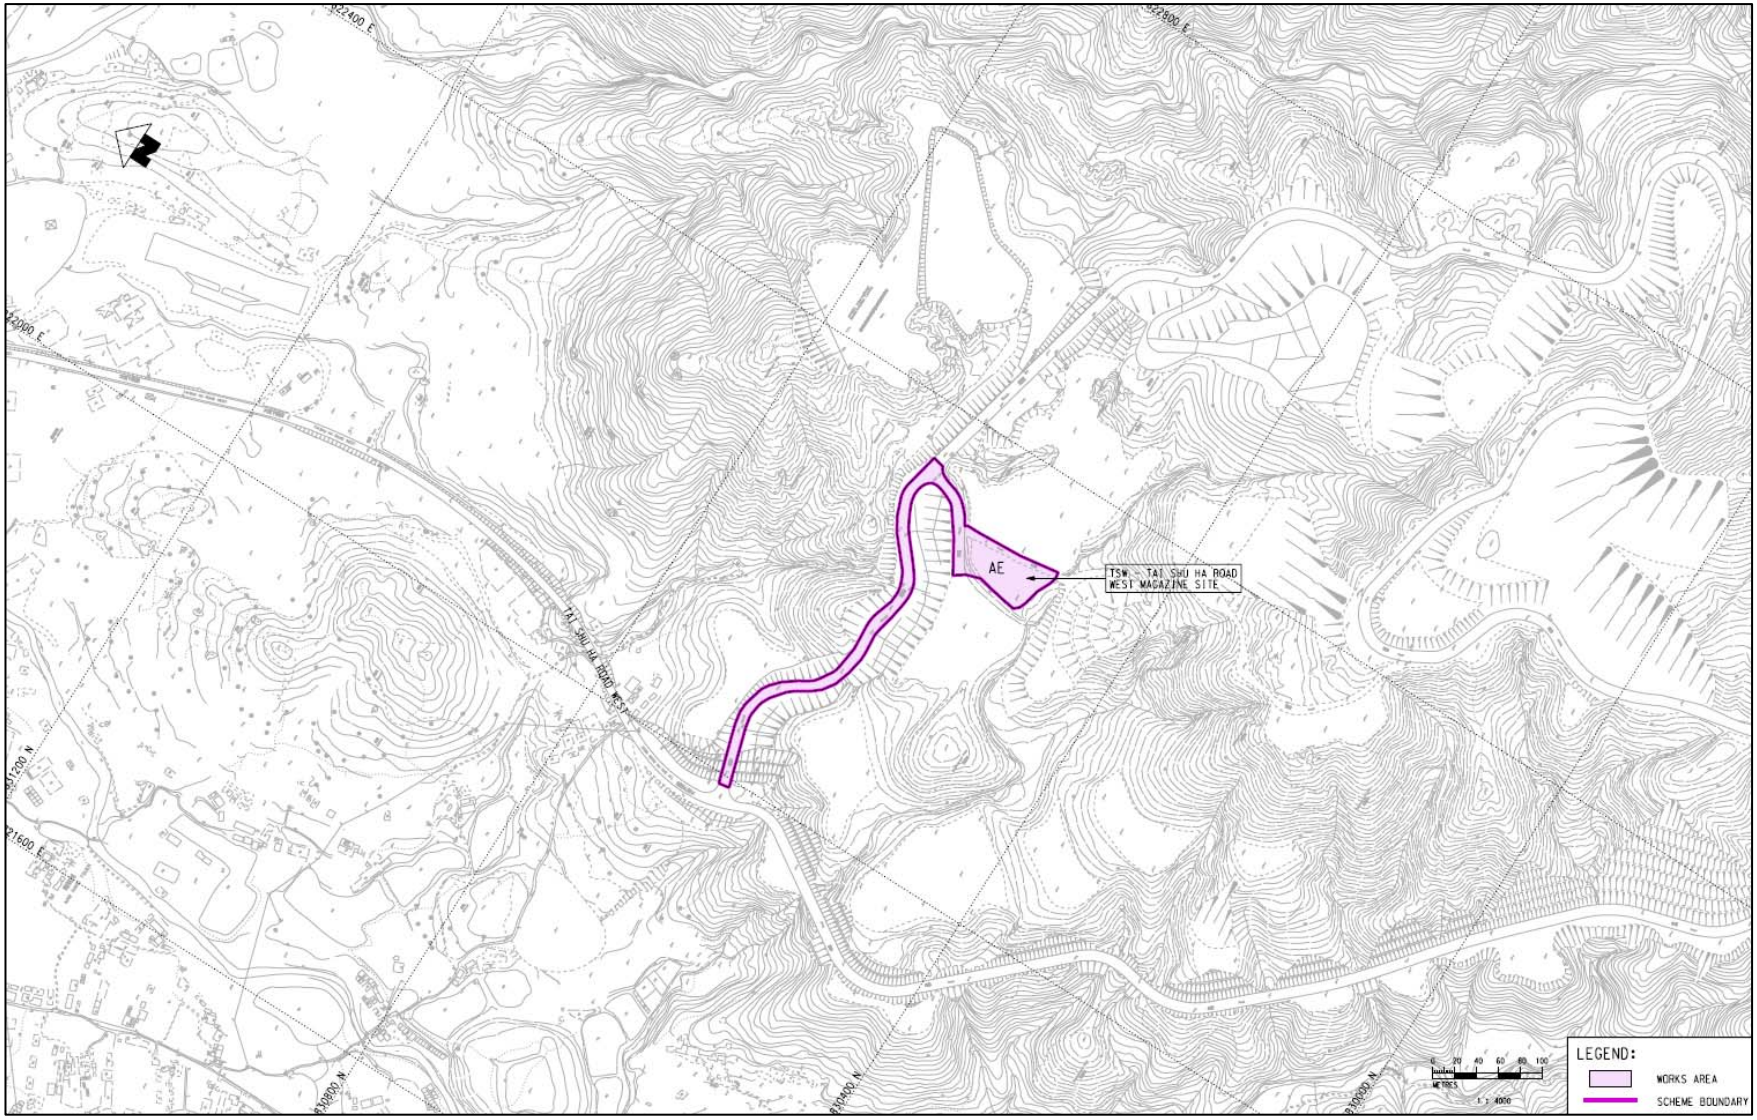
822400 E
822800 E
821200 E
821600 E
810800 N
810400 N
810000 N
AE
TSW - TAI SHU HA ROAD WEST MAGAZINE SITE
TAI SHU HA ROAD WEST
0 20 40 60 80 100
METRES
1 : 4000
LEGEND:
WORKS AREA
SCHEME BOUNDARY


821600 E
822000 E
822400 E
22400 N
22000 N
TSING CHAU WAN
TSING CHAU WAN
AG
TCB - TSING CHAU TSAI BARGING POINT
TOLL PLAZA
AIRPORT EXPRESS
NORTH LANTAU HIGHWAY
TSING CHAU TSAI
0 15 30 45 60 75
LEGEND:

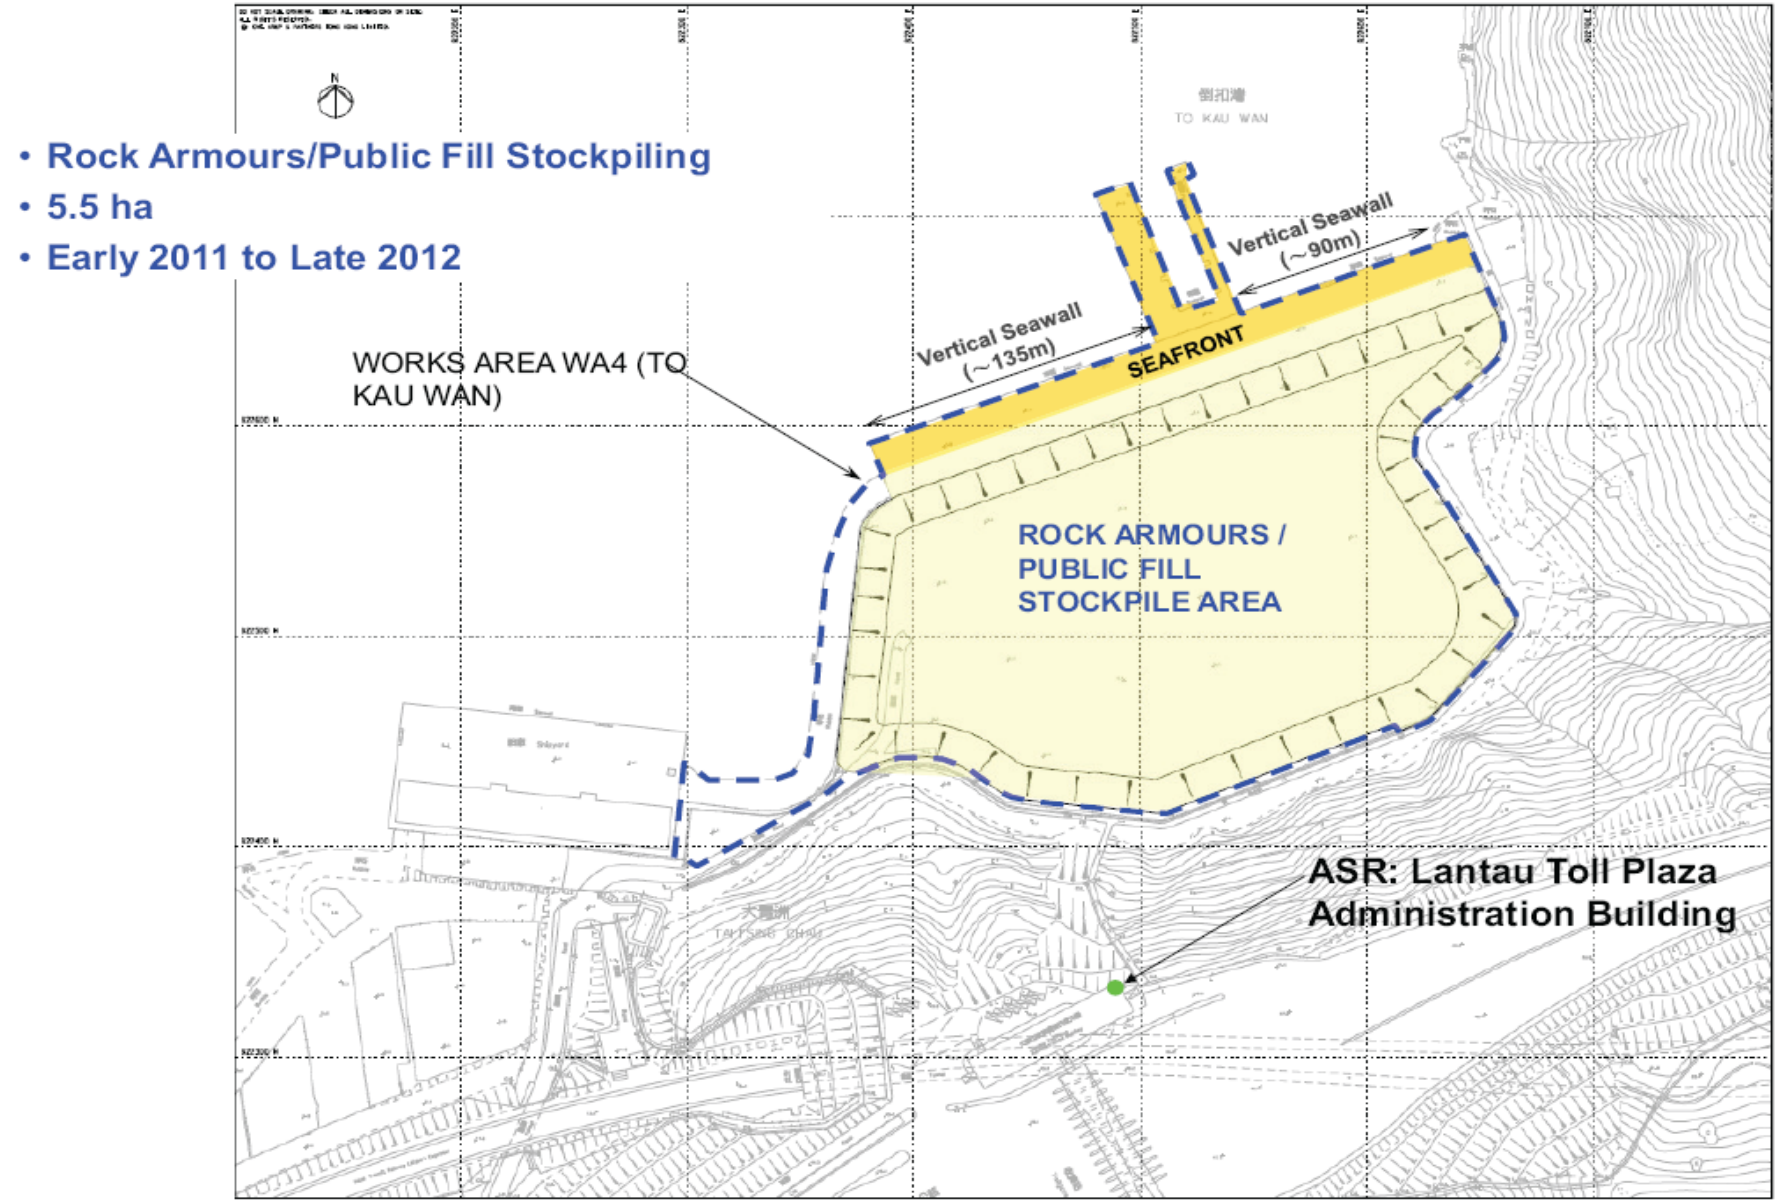

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link Environmental Review Report – Stock Piling Facility in To Kau Wan	SCALE	N.T.S.	DATE	Dec-10
	Location Plan for To Kau Wan Stockpiling Area	DRAWING NO.	Figure 2.1		

Appendix B

Project Management Organization and Contacts of Key Personnel

Title	Name	Telephone
Engineer's Representative		
Construction Manager (802, 805, 820 & 821)	Mr. Bill Clowes	3605 0056
Construction Manager (803 A/B)	Mr. Samuel Lo	3575 5641
Construction Manager (803 D & 810 B)	Mr. KS Lim	3575 5723
Construction Manager (811 A & B)	Mr. Albert Lam	3575 1357
Construction Manager (822, 823 A & 823B)	Mr. Andy Fok	2208 3732
Construction Manager (824 and 825)	Mr. Ivan Chau	2208 3334
Independent Environmental Checker		
Divisional Manager	Dr. Anne Kerr	2828 5793
Environmental Team		
Environmental Team Leader	Mr. Glenn Frommer	2688 1552
Deputy Environmental Team Leader	Mr. Richard Kwan	2688 1179
Contractor		
Contract 802 Contractor		
Project Manager	Frankie Lam	6021 2602
Environmental Officer	Andy Leung	9863 9305
Contract 803A Contractor		
Project Manager	Dick YIU	9426 4657
Site IMS Manager	Nick LAU	9216 9245
Contract 803B Contractor		
Project Manager	Fung Lai Man	9252 4204
Environmental Officer	Mr. C.K. Yau	9203 6046

Title	Name	Telephone
Contract 803D Contractor		
Project Manager	Dick YIU	9426 4657
Site IMS Manager	Nick LAU	9216 9245
Contract 805		
Project Manager	Hobby LAU	9828 0638
Environmental Engineer / Officer	Justin Lai	6330 6726
Contract 810B Contractor		
Project Director	Mr. Smollett LEE	6629 4441
Environmental Manger	Mr. Calvin SZE	9205 9277
Contract 811A Contractor		
Project Manager	Bob Aylmer	2561 8072
Quality, Safety and Environmental Manager	Keith Gordon	3994 8345
Environmental Officer	Kevin Wong	2164 2832
Contract 811B Contractor		
Project Manager	Chris Williams	9669 2665
Construction Manager	Anthony Zervaas	6011 8178
Environmental Manager	Brian Kam	9456 9541
Environmental Officer	Sammie Chan	6407 3833
Contract 820 & 821 Contractor		
Project Director	Alain Hervio	2215 6600/ 6112 9197
Senior QSE Manager	Y. T. So	2215 6631/ 9307 8728
Environmental Officer	Marcus Cheung	2215 6632

Title	Name	Telephone
Contract 822 Contractor		
Environmental & Quality Manager	Mr. Brian Pickering	6323 5753
Environmental Manager / Officer	Mr. David Hung	9765 6151
Environmental Coordinator	Ms. Jane Huang	6491 4620
Contract 823A & B Contractor		
Project Manager	Philip Davies	2411 7600
Environmental Officer	Wendy Ng	2411 7608
Contract 824 Contractor		
Works Manager	Ian Sweeney	9759 8192
Environmental Officer	Patrick Sin	6022 8646
Contract 825 Contractor		
Project Manager	Mr. Nakayama	2482 8101
Environmental Manager	Mr. Kenneth Lau	9723 4718

Appendix C

Implementation Status

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
Ecological Impact (Detailed design Phase / Pre-construction Phase)						
S3.398	- Prior to commencement of channel works, an ecological habitat management plan should be prepared to provide the detailed specifications for the habitats and ecological functions to be provided, and control of colonization of invasive plant species at the mitigation stream habitats and define the long-term management and ecological monitoring and audit requirements for these habitats.	To mitigate the avoidable loss of watercourse habitat	MTR	SSS	Detailed design phase / Prior to commencement of channel works	Ecological Habitat Management Plan (EHMP) formulated and submitted to EPD
S3.388 - S3.397	- The constructed channel in the SSS site should include open channel with ecologically friendly stream feature to mitigate the direct impact due to the loss of a watercourse habitat in Shek Kong.	To mitigate the avoidable loss of watercourse habitat	MTR / DDC	SSS	Detailed design phase	AFCD's comment has been sought during formulation of the EHMP
S3.410	- The implementation details of the impact monitoring programme should be described in ecological monitoring plan for EPD approval before commencement of construction activities.	To outline details of ecological impact monitoring	MTR	MPV, TPP, SSS / ERS, PHV and TUW	Before commencement of construction activities	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S3.327 & S3.412	- A monitoring and emergency response plan (to be prepared by the Contractor), in relation to potential impacts due to groundwater drawdown, will form part of the EM&A requirement in the EM&A Manual subject to approval by EPD and AFCD before commencement of the tunnelling and MPV construction in Mai Po area. The plan should include, but not be limited to, details of monitoring locations and programme, a mechanism to monitor the implication from the works to the groundwater system and fish pond, action levels and emergency responses such as immediate action, remedial action and investigation.	To detect potential impacts due to groundwater drawdown	Contractor	MPV	Before commencement of the tunnelling and MPV construction	AFCD's comment has been sought during formulation of Plan
S3.413	- A monitoring and emergency response plan, in relation to impacts due to noise/vibration, should form part of the EM&A requirement in the EM&A Manual subject to approval by EPD and AFCD before commencement of the tunnelling and MPV construction in Mai Po area.	To detect and monitor noise / vibration impacts	Contractor	MPV	Before commencement of bore tunnelling and MPV construction	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
Ecological Impact (Construction Phase)						
S3.325 - S3.326	- Implementation of precautionary measures during tunnelling works.	To avoid potential hydrogeological impacts	Contractor	All works areas	Construction phase	Implemented
S3.409 to S3.410	- Ecological impact monitoring focusing on habitats and species of conservation interest should be conducted during the construction phase at the MPV, TPP, SSS / ERS, PHV, and TUW sites where a number of avifauna of conservation interest (e.g. overwintering bird, Greater Painted-snipe) and areas of conservation interest (e.g. country parks, conservation areas, and wetlands) were recorded. - Avifaunal communities should be surveyed quantitatively along transects. Birds heard or seen along the transects should be identified to species and counted. The nature of construction works within works area conducting during each impact monitoring visit should also be recorded. The quantitative monitoring results should be compared to pre-construction condition. The impact monitoring results should be undertaken by qualified ecologist(s) with relevant working experience.	To monitor potential indirect construction impacts to wildlife	MTR MTR	MPV, TPP, SSS / ERS, PHV, and TUW	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	- Should any unpredicted indirect ecological impacts arising from the proposed Project be detected, remedial measures should be developed and implemented by the Contractor.		Contractor			
S3.327 & S3.412	- Implementation of the groundwater monitoring and emergency response plan.	To detect and minimize hydrological impacts	Contractor	MPV	Construction phase (During bore tunneling works and construction of Mai Po Ventilation Shaft)	Refer to Item for S3.327 & S3.412.
S3.413	- Implementation of monitoring and emergency response plan on noise and vibration.	To detect and minimize noise / vibration impacts	Contractor	MPV	Construction phase (During bore tunneling works and construction of Mai Po Ventilation Shaft)	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S3.364 -S3.369	- Use of quiet construction plant and temporary noise barriers. - Access to the ventilation building sites should follow existing access roads, such as the maintenance access along the existing drainage channels. - Site hoarding of about 2.4 m high should be erected around the works area of access roads along drainage channels in the TPP and SSS / ERS sites. - Gate and fences should be installed along the construction accesses that are adjacent to public areas. - Gates and hoardings should be provided at the entrances/exits and along the boundary of the works areas respectively to prevent any trespassers from encroaching or will fully disturbing any wild animals and their habitats within the works areas. - A trip-ticket system should be adopted to monitor the disposal of construction and demolition materials. CCTV and warning signs should be provided at the entrance of the proposed temporary and permanent	To minimise impacts to surrounding habitats	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	vehicular access.					
3.370 -3.371 and 3.373	- Vegetation located within the works areas should be preserved as far as practicable. - To avoid soil compaction, heavy machinery should not be used in close proximity to vegetation. Soils that become compacted through the activities of the development should be loosened to an appropriate depth to allow seed germination. - All temporarily affected habitats should be reinstated after the completion of works. - Placement of equipment or stockpiles should be confined to designated works areas. Access routes should be confined on existing disturbed land, where practicable.	To minimize impacts to vegetation	MTR / Contractor	All works areas	Construction phase	Implemented
	- Detailed vegetation survey should be conducted in TSW site prior to commencement of site clearance.	To minimize impacts to vegetation	MTR / Contractor	TSW	Prior to commencement of site clearance	Vegetation Survey Report formulated and deposited

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
						to EPD
	- To mitigate the loss of the vegetation and habitats, planting of native species should be provided in the areas affected by the Project in TSW site, and other works area, where practicable.	To minimize impacts to vegetation	MTR / Contractor	TSW and all other works areas	Construction phase	Proposal of mitigatory planting at TSW was included in the Vegetation Survey Report. Mitigatory planting to be implemented as per construction programme
S3.372	- The affected individuals of Incense Tree within the NTV works area should be transplanted to nearby suitable habitats prior to the commencement of site clearance at NTV works area as far as practicable. - A detailed vegetation survey covering the affected	To minimize impacts to vegetation	MTR / Contractor	NTV	Construction phase	Vegetation survey was conducted and included in the Vegetation

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	habitat at NTV works area should be conducted by a suitably qualified botanist / ecologist to identify and record the affected individuals in order to provide details for the transplantation scheme prior to the commencement of site clearance. Feasibility and suitability of transplanting the affected individuals would be studied and suitable receptor sites would be identified. The transplantation proposal for the affected individuals should be prepared as necessary and transplantation should be supervised by a suitably qualified ecologist / horticulturist.					Survey Report. Transplantation of Incense Tree was completed and monitored.
S3.374 - S3.377	- Site hoarding of 2.4 m high should be set up along the boundary of the works areas as far as practicable.	To minimize disturbance to wildlife	Contractor	All works areas	Construction phase	Implemented
	- The erection of hoarding (2.4 m) along KT5 in the area with high Greater Painted-snipe occurrence (e.g. the proposed access road next to KT5) should avoid their breeding season, prior to construction activities in the area.			KT5 (near TPP)	Prior to the construction of access road	Implemented
	- The use of noisy construction equipment such as hydraulic breakers should be avoided at the area with			KT5 (near TPP)	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	high painted-snipe occurrence (e.g. the proposed access road next to KT5) during their breeding season as far as practicable.					
	- Hoardings of 2.4 m height should be put in place before commencement of construction activities. Hoarding at the section along the northern boundary of the MPV works area should be installed first. The duration of hoarding erection should be kept as brief as practicable. - Upon the erection of site hoarding, all construction activities should be conducted within the fenced area.			MPV	Right after possession of site	Implemented
	- Major construction site lighting should point inward and downward. Unnecessary lighting should be turned off outside working hours of the construction sites.			All works area	Construction phase	Implemented
S3.378 - S3.380	- Excavation works carried out within waterbodies should be carried out in dry season where practicable. - Excavation works within the watercourse / drainage channel should be restricted when possible to an	To minimise pollution to waterbodies	Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	enclosed dry section of the watercourse / drainage channel, with containment measures such as bunds and barriers used within the watercourse / drainage channel. - Site runoff should be directed towards regularly cleaned and maintained silt traps and oil / grease separators. The silt and oil / grease separators should be appropriately designed for the local drainage and ground conditions. Tightly sealed closed grab excavators should be deployed where material to be handled is wet. - The flow of the watercourse and drainage channel located with the Project Area should be maintained throughout the construction phase.					
Terrestrial Ecological Impact (Post-construction / Operation Phase)						
S3.327 & S3.412	- Implementation of the groundwater monitoring and emergency response plan.	To detect and minimize hydrogeological impacts	Contractor	MPV	Post-construction phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S3.381	- The affected agricultural land should be restored to a condition suitable for agricultural use before handing over to landowners / operators.	To minimize impacts to surrounding habitats	MTR / Contractor	All temporarily occupied agricultural land	Operation phase	To be implemented as per construction programme
S3.382 – S3.384	- Vegetation control in the constructed channels should be implemented to prevent the excessive growth of vegetation that would impede the drainage capacity of the channel. To minimise sedimentation, de-silting should be limited to the dry season (November to March). The natural stream bed substrate should not be removed from the channel during de-silting works. - For maintenance de-silting, temporary barrier walls should be used to provide a dewatered zone for de-silting works. Waste material produced during de-silting should be disposed of in a timely and appropriate manner.	To minimise impacts to constructed channels	MTR	All constructed channels in SSS	Operation phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S3.385 & S3.387	- Large areas of reflective material (including glass) should not be used on the outer surfaces of the buildings. - All the major lighting sources should point inward and downward to minimise glare disturbance to wildlife. The intensity of light should also be controlled to the lowest possible level.	To minimise impacts to wildlife	MTR / DDC	All ventilation buildings in northern section and SSS	Detailed design and Operation phases	To be implemented as per construction programme
S3.411	- Implementation of ecological habitat management plan. - Ecological monitoring of the mitigation stream habitats according to ecological habitat management plan.	To monitor the wildlife use of the mitigation stream habitat	MTR	Mitigation stream habitat in SSS / ERS	Operation phase	To be implemented as per construction programme
Marine Ecological Impact (Construction Phase)						
Appendix3.6 (S1.102)	- The use of high-speed vessels should also be avoided during the construction and operation of the proposed barging point.	To minimise the indirect impact to Chinese White Dolphin habitat	Contractor	LKB	Construction phase	To be implemented as per construction programme
Appendix3.6	- No dumping of rubbish, oil or chemicals would be allowed.	To minimise the pollution to marine habitats	Contractor	LKB	Construction phase	To be implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
(S1.103)						as per construction programme
Appendix3.6 (S1.104)	- Deployment of silt curtains around the closed grab dredgers to minimize the suspended sediment impact due to dredging activities in dredging region. - To minimize impact on the gorgonians along the coastline near the dredging area, double silt curtains should be deployed around the works area.	To minimise the impact to subtidal habitats	Contractor	LKB	Construction phase	To be implemented as per construction programme
Appendix3.6 (S1.106)	- The number of work vessels and small crafts should be minimized. Dredging should be carried out continuously without unnecessary break to prevent unpredictable or sudden noise outbursts at random intervals.	To minimise disturbance impact on Chinese White Dolphin	Contractor	LKB	Construction phase	To be implemented as per construction programme
Appendix3.7 (S1.83)	- Mitigation measures to control water quality impacts proposed under Section 11 should be adopted.	To minimise indirect impact to intertidal and subtidal flora and fauna	Contractor	WKT	Construction phase	Implemented
Appendix3.6 (S1.105)	- Engines of vessels moored at the barging point would be turned off to minimize unnecessary underwater	To minimise disturbance impact on Chinese White Dolphin	Contractor	LKB	Construction phase	To be implemented as per

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	noise.					construction programme
Pond Fisheries Impact (Pre-construction Phase)						
S4.51	- A monitoring and emergency response plan, in relation to potential impacts due to groundwater drawdown, will form part of the EM&A requirement in the EM&A Manual subject to approval by EPD and AFCD before commencement of the tunnelling and MPV construction in Mai Po area. The plan should include, but not be limited to, details of monitoring locations and programme, a mechanism to monitor the implication from the works to the groundwater system and fish ponds including their water levels, action levels and emergency responses such as immediate action, remedial action and investigation.	To detect and minimize potential hydrological impacts	Contractor	MPV	Pre-construction phase (Before commencement of the tunnelling and MPV construction)	AFCD's comment has been sought during formulation of Plan
S4.52	- A monitoring and emergency response plan, in relation to impacts due to noise/vibration, should form part of the EM&A requirement in the EM&A Manual subject to approval by EPD and AFCD	To detect and monitor noise / vibration impacts	Contractor	MPV	Pre-construction phase (Before commencement of bore	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	before commencement of the tunnelling and MPV construction in Mai Po area.				tunnelling and MPV construction)	
S4.45	- Consultation should be conducted with fish operators in Mai Po before tunnelling starts. The method of construction, potential impact and mitigation measures should be fully explained to the operators at the meeting.	Engagement of stakeholders	Contractor / MTR	MPV	Pre-construction phase (Before commencement of tunneling works)	Consultation with Mai Po Village VR has been conducted.
Pond Fisheries Impact (Construction Phase)						
S4.51	- Implementation of the groundwater monitoring and emergency response plan.	To detect and minimize hydrogeological impacts	Contractor	MPV	Construction phase (During bore tunneling works and construction of Mai Po Ventilation Shaft)	Implemented
S4.52	- Implementation of the monitoring and emergency response plan on noise and vibration.	To detect and minimize noise / vibration impacts	Contractor	MPV	Construction phase (During bore tunneling works and	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
					construction of Mai Po Ventilation Shaft)	
S4.40	- Good site practices and proper dust and water quality control measures should be implemented. These include site confinement with fencing/hoarding erection at the perimeter of the works area, stockpile covering by impervious sheeting to avoid spread of construction dust, and proper handling, storage and disposal of chemical waste to avoid contamination of the existing water system, etc.	To minimize the indirect off-site impacts on the adjacent fishponds	Contractor	MPV	Construction phase	Implemented
S4.44	Implementation of good site practices during the construction phase: ▪ Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program; ▪ Silencers or mufflers on construction equipment should be utilized and properly maintained during the construction program;	To minimize disturbance to fishponds by construction noise	Contractor	MPV	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; ▪ Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby fishponds; ▪ Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities; ▪ Use of movable barrier for certain powered mechanical equipment (PME); and ▪ Use of noise enclosure or acoustic shed to cover certain stationary PME.					
Pond Fisheries Impact (Post-construction Phase)						
S4.51	- Implementation of the groundwater monitoring and emergency response plan.	To detect and minimize hydrogeological impacts	Contractor	MPV	Post-Construction phase	To be implemented as per construction programme
Marine Fisheries Impact (Construction Phase)						
Appendix4.2	- Mitigation measures to control water quality impacts	To minimize the indirect impact on fisheries	Contractor	LKB and WKT	Construction phase	To be implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
(S1.38)	proposed under Section 11 should be adopted.	resources				as per construction programme
Airborne Noise Impact (Construction Phase)						
S5.120	The following good site practices should be implemented: ▪ Only well-maintained plant should be operated on-site and plants should be serviced regularly during the construction program; ▪ Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program; ▪ Mobile plant, if any, should be sited as far from noise sensitive receivers (NSRs) as possible; ▪ Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; ▪ Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and ▪ Material stockpiles and other structures should be effectively utilized, wherever practicable, in	To reduce construction noise impact	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	screening noise from on-site construction activities.					
S5.121-S5.122 and Table 5.22	The following quiet PME should be used: ▪ Pneumatic breaker (SWL=110dB(A)) ▪ Tracked Excavator Fitted with Hydraulic Breaker (SWL=110dB(A)) ▪ Truck Mixer (SWL=100dB(A)) ▪ Tracked Crane (SWL=101dB(A)) ▪ Dump Truck (SWL=103dB(A)) ▪ Tracked Excavator/Loader (SWL=105dB(A)) ▪ Dozer (SWL=111dB(A)) ▪ Road Roller (SWL=101dB(A))	To reduce construction noise impact	MTR / Contractor	Works Areas A, B, C, D, E, F, G, H, I, J, K, L, M, N, O, P, Q, R, S, T, U, V, W, Y, Z, AA, AC, AE, AF, AG and AH	Construction phase	Implemented
S5.123 - S5.124	Movable noise barrier should be used for the following PME where practicable: ▪ Mini backhoe ▪ Breaker, mini-robot mounted ▪ Vibratory poker ▪ Handheld breaker ▪ Excavator ▪ Grab	To reduce construction noise impact	MTR / Contractor	Works Areas A, C and D	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Tracked Crane					
S5.125	Noise enclosure/acoustic shed should be used for the following PME where practicable: ▪ Air compressor ▪ Concrete pump ▪ Grout pump ▪ Shotcrete pump	To reduce construction noise impact	MTR / Contractor	Works Areas A, B, C, D, E, F, G, H, I, J, K, L, M, O, P, Q, S, T, U, V and Z	Construction phase	Implemented
S5.125	Acoustic enclosure should be used for enclosing drilling jumbo as fully as possible.	To reduce construction noise impact	MTR / Contractor	Works Areas B, C, F, H and J	Construction phase	Implemented
S5.127	Silencer should be used for the ventilation fans.	To reduce construction noise impact	MTR / Contractor	Works Areas A, B, C, D, E, F, H, J, L and P	Construction phase	Implemented
S5.128	Noise insulating fabric should be applied where practicable to cover the following PME: ▪ Drill rig ▪ Grab and chisel ▪ Oscillator & casings ▪ Piling rig	To reduce construction noise impact	MTR / Contractor	Works Areas A, B, C, D, E, G, L, M, N, O, Q, R, S, V	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Piling, large diameter bored, reverse circulation drill ▪ Piling, vibrating hammer					
S5.130	Use of "Noise Insulating Cover" to cover the mucking out points.	To reduce construction noise impact	MTR / Contractor	Works Area L	Construction phase	To be implemented as per construction programme
S5.131	Use of temporary hoardings along the works boundary.	To reduce construction noise impact	MTR / Contractor	Works Areas B and D	Construction phase	Implemented
S5.134-S5.136	Use of saw instead of mini-robot mounted breaker and oscillator pile for removal of superstructures	To reduce construction noise impact	MTR / Contractor	Works Areas N, O and S	Construction phase	Implemented
S5.137	Scheduling of construction works outside school examination periods	To reduce construction noise impact	MTR / Contractor	Works Areas G, J, K, L, N, O, P, Q, Y, U, V and AH	Construction phase	Implemented
S5.193	Airborne construction noise monitoring should be conducted in accordance with EM&A Manual to monitor the airborne noise impact.	To monitor airborne noise impact	MTR / Contractor	Proposed monitoring locations	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
Airborne Noise Impact (Operation Phase)						
S5.113 and Table 5.21	The maximum permissible sound power levels (Max SWLs) for the fixed plant should be complied with during the selection of equipment and mitigation measures.	To comply with the noise criteria of Noise Control Ordinance	MTR / DDC	MPV, NTV, PHV, SMV, KCV, NCV, MKV, WKV and WKT	Detailed design and operation phases	To be implemented as per construction programme
S5.140	Noise barrier should be erected as follow: ▪ A 8m high barrier along the access road on eastern side of SSS; and ▪ 5.5m barrier along western boundary facing Leung Uk Tsuen squats.	To comply with the noise criteria of Noise Control Ordinance	MTR / DDC	SSS	Detailed design and operation phases	To be implemented as per construction programme
S5.140	Installation of 13m absorptive panels on both sides and full length of ERS.	To comply with the noise criteria of Noise Control Ordinance	MTR / DDC	ERS	Detailed design and operation phases	To be implemented as per construction programme
S5.196	Noise commissioning test is recommended to monitor the ground-borne noise level complying with NCO.	To monitor ground-borne noise impact	MTR / Contractor	Proposed monitoring locations	Operation phase	To be implemented as per

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
						construction programme
Ground-borne Noise Impact (Construction Phase)						
S6.82	Ground-borne construction noise monitoring should be conducted in accordance with EM&A Manual to monitor the ground-borne noise impact.	To monitor ground-borne noise impact	MTR / Contractor	Proposed monitoring locations	Construction phase	To be implemented as per construction programme
S6.85	Construction groundborne noise measurement results should be used to further update the ground-borne noise prediction where appropriate.	To update the predicted ground-borne noise levels.	MTR / Contractor	TBM tunneling section	Construction phase	To be implemented as per construction programme
S6.83	Conduct tests of the FDL of the train to update the ground-borne noise prediction and the recommended mitigation measures as necessary.	To confirm the predicted ground-borne noise levels	MTR	-	Prior to the final design of the trackform and the extent of each type of trackform, and after the proposed train in operation	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
					outside Hong Kong	
S6.84	Conduct vibration borehole testing at two carefully selected locations along the proposed tunnel alignment to determine the LSR values under certain geological conditions. The ground-borne noise predictions and the recommendation on mitigation measures should be updated as necessary.	To confirm the predicted ground-borne noise levels	MTR	Proposed two locations	Prior to the commencement of construction works	To be implemented as per construction programme
Ground-borne Noise Impact (Operation Phase)						
S6.87	Noise commissioning test is recommended to monitor the ground-borne noise level complying with NCO.	To monitor ground-borne noise impact	MTR / Contractor	Proposed monitoring locations	Operation phase	To be implemented as per construction programme
Landscape and Visual Impact (Construction Phase)						
Table 7.10	All existing trees should be carefully protected during construction as far as possible in accordance with ETWB TCW No. 29/2004 and 3/2006.	To minimize landscape and visual impacts during construction phase	Contractor	Works areas	Detailed design and construction phases	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	Trees should be retained on site as far as possible. Should removal of trees be unavoidable due to construction impacts, trees will be transplanted or felled depending on stated criteria in the Tree Removal Applications to be submitted separately in accordance with ETWBC 2/2004 and 3/2006. Wood resulting from tree removal should be recycled as mulch or soil conditioner which could be used within the Project or in other projects as much as possible.		Contractor			
	Control of night-time lighting glare.		Contractor			
	Erection of decorative screen hoarding to screen off undesirable views of the construction site having consideration of safety and security.		Contractor			
	Reuse of existing topsoil where possible for new planting areas within the project.		Contractor			
Landscape and Visual Impact (Operation Phase)						
Table 7.11	Compensatory tree planting should be incorporated into the proposed Project where space is available	To minimize landscape and visual impacts during operation phase	MTR	Works areas	Detailed design and operation phases	To be implemented as per construction programme
	Landscape and visual enhancement treatments		MTR			
	Compensatory habitat proposal for natural stream course		MTR			

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	at SSS					
	Reinstatement of works area in Nam Cheong Park to integrate with the existing park.		MTR			
	Tall buffer tree planting should be incorporated provide screening to ventilation buildings, engineering structures and associated facilities.		MTR			
	Roof greening to mitigate the visual impact of VB on the VSRs at high level.		MTR			
	Vertical greening would be incorporated where practicable to visually soften the façade of ventilation building and/or noise barrier		MTR			
	Incorporation of aesthetically pleasing streetscape design which would be responsive to adjacent landscape context.		MTR			
	Roadside amenity trees to enhance the landscape and visual quality of the existing and proposed road.		MTR			
	Reinstatement of disturbed areas to match adjacent area or to condition to suit future landuse.		MTR			
	Aesthetically pleasing design as regard to the form, material and finishes shall be incorporated to all buildings, engineering structures and associated infrastructure facilities so as to blend in the buildings and		MTR			

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	structures to the adjacent landscape and visual context.					
	Control of Operation Night-time Glare		MTR			
	Incorporation of aesthetically pleasing design to boundary fence so as to blend in the structure to the adjacent landscape and visual context.		MTR			
	The scale, location, disposition and design of the ventilation shafts at WKCD would be further reviewed and submitted to relevant parties (e.g. WKCDA and PlanD) for agreement.		MTR			
Cultural Heritage Impact						

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S8.100 – S8.103	• Conduct further investigation (a minimum of 18 trial pits, 1m x 1.5m) to confirm any archaeological remains exist in the inaccessible areas (**NOL/ERL/300/C/XRL/ENS/M55/303- 304 & 306-307**). If archaeological data collected from these 18 test pits is insufficient to ascertain the archaeological potential of the inaccessible areas, additional test pits should be conducted • Conduct rescue excavation to preserve archaeological remains by detailed records if found (**NOL/ERL/300/C/XRL/ENS/M55/307**)	To confirm any archaeological remains exist in the inaccessible areas and to preserve archaeological remains if any	MTR	Proposed rescue excavation area in SSS and other archaeological deposit areas identified in the further archaeological investigation	Prior to construction phase	Further Archaeological Investigation has been conducting according to Archaeological Action Plan formulated
S8.103	Conduct archaeological watching brief during construction works at TUW for identification of any historical finds during construction phase	To identify any historical finds in the works area	MTR	TUW	Construction phase	Implemented
S8.104	Conduct regular site audit during the construction of barging point to confirm that no excavation works is conducted at Lung Kwu Sheung Tan archaeological deposit area.	To avoid direct impact	MTR	LKST barging point and associated access road	Construction phase	To be implemented as per construction programme
S8.105	Restriction of works boundary of TPP to be extended to relics discovered area outside TPP.	To avoid direct impact	MTR	TPP	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S8.107, S8.128	Avoid works areas at the sites of the identified built heritage structures as far as practicable. Identified earth shines within works boundary of SSS and TPP will be relocated by local villagers prior to commencement of construction works at SSS and TPP.	To avoid direct impact	MTR	Earth shines (NHL-04,TKP-02 and LET-07)	Prior to construction phase	Implemented
S8.109, S8.125	Vibration monitoring at Lai Chi Kok Hospital: ▪ Prior to commencement of construction works, the location and installation of the monitoring stations should be discussed and agreed with AMO, Hong Kong Institution for Promotion of Chinese Culture (the "NPO", selected organization for the Revitalisation Scheme), the Commissioner for Heritage's Office and relevant parties before installation. ▪ Compliance monitoring of vibration limits should be conducted and reported as a requirement of EM&A programme.	To monitor vibration impacts on the identified vibration sensitive historical buildings	MTR	Ex-Lai Chi Kok Hospital	Before construction phase; Construction phase	To be implemented as per construction programme
S8.110, S8.126	▪ A further condition survey and appropriate consolidation works (e.g. installation of temporary propping or reinforced timber beam to maintain the stability of structure etc.), if required, will be carried out on Blocks P Q, W and the inaccessible area of	To minimize vibration impacts on the identified vibration sensitive historical buildings	MTR	Ex-Lai Chi Kok Hospital	Detailed design	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	LCKH prior to construction. It should be discussed and agreed in advance with AMO, NPO, the Commissioner for Heritage's Office and relevant parties,					
S8.112, S8.127	▪ If consent is given by the property owner, a condition survey will be carried out at Cheung Yuen prior to the commencement of works in SSS. The survey should be discussed and agreed in advance with AMO and property owner prior to commencement of survey.	To minimize vibration impacts on the identified vibration sensitive historical buildings	MTR	Cheung Yuen	Prior to construction phase	AMO's comment has been sought during formulation of Vibration Monitoring Plan
S8.112, S8.127	▪ If consent is given by the property owner, vibration monitoring at LET-06 (Cheung Yuen) will be conducted when excavation works are being conducted within 50m radius from the house. The monitoring location should be discussed and agreed with AMO and property owner before installation.	To monitor vibration impacts on the identified vibration sensitive historical buildings	MTR	Cheung Yuen	Construction phase	Implemented
S8.113, S8.124	▪ Control of vibration levels from the proposed blasting and excavation activities within a peak particle velocity (ppv) limit of 25mm/s to prevent	To minimize vibration impacts on the identified vibration sensitive	MTR	All works area where blasting and	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	potential vibration impact to all identified built heritage resources.	historical buildings		excavation activities are involved		
S8.114 - S8.115	▪ Use of sensibly designed screen hoardings for reducing the potential visual impact.	To minimize visual impacts	MTR	All identified heritage buildings in all works areas	Detailed design and construction phase	Implemented
Land Contamination Impact						
S9.28 – S9.33	Remediation of Contaminated Soil ▪ After excavation, confirmation sampling and testing shall be conducted from the sidewalls and at base of the excavations to ensure complete excavation of contaminated soils. ▪ Bioremediation (biopiling) / ex-situ chemical oxidation are proposed to remediate the contaminated soil recorded in Sites H and Q. Remediation Report(s) (RR) for contaminated works area(s) should be prepared by the Land Contamination Specialist to detail the remediation process and demonstrate that contaminated soils are all removed, properly handled and disposal of. The remediated soil should be reused on site to	To remediate contaminated soil	Contractor	Sites H and Q	Site remediation	For Site H: Remediation has been conducting according to the approved Supplementary RAP. For Site Q: To be implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	minimise the waste disposal.					as per construction programme
S9.35(i)	For construction works of the alignment close to Ngau Tam Mei Landfill ▪ As a general precautionary measure, visual inspection of excavated materials should be conducted to screen soil for signs of contamination (e.g. discoloration, stains and odour). The inspection process should also be assisted by a photo ionization detector (PID) for volatile organics. If suspected materials are encountered during tunnel boring, sampling and testing for the parameters recommended in Table 6.1 of CAP should be undertaken to verify any contamination. The suspected soil bored out during excavation and tunnel boring should be temporary stockpiled and if laboratory analysis indicated exceedance of relevant RBRG levels, remediation works, should be undertaken depending on the quantity and quality of contaminated soil identified.	Acting as a general precautionary measure to screen soil for signs of contamination during tunnel boring works under/close to Ngau Tam Mei Landfill	MTR/Contractor	Within the Landfill Boundary where signs of contamination is identified	During Tunnel Boring within Ngau Tam Mei Landfill Boundary Section	To be implemented as per construction programme
S9.35(ii)	For construction works at CLP transformer station at Lai Cheung Road and Petrol Filling Station at 82 Tai Kok Tsui Road ▪ As a general precautionary measure, visual	Acting as a general precautionary measure to screen soil for signs of contamination during	MTR/Contractor	Area close to CLP transformer station at Lai	During Tunnel Boring/ excavation works near CLP	To be implemented as per construction

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	inspection of excavated materials should be conducted to screen soil for signs of contamination (e.g. discoloration, stains and odour). The inspection process should also be assisted by a photo ionization detector (PID) for volatile organics. If suspected materials are encountered during tunnel boring, further sampling and testing should also be undertaken to verify any contamination. The soil bored out during excavation and tunnel boring should be temporary stockpiled and if laboratory analysis indicated exceedance of relevant RBRG levels, remediation works, should be undertaken depending on the quantity and quality of contaminated soil identified.	tunnel boring/ excavation at CLP transformer station at Lai Cheung Road and Petrol Filling Station at 82 Tai Kok Tsui Road		Cheung Road and Petrol Filling Station at 82 Tai Kok Tsui Road where signs of contamination is identified	transformer station at Lai Cheung Road and Petrol Filling Station at 82 Tai Kok Tsui Road	programme
S9.35 (iii)	For sites with contamination identified (Site H and Site Q) the following environmental mitigation measures should be undertaken during the course of the site remediation: ▪ Excavation profiles must be properly designed and executed with attention to the relevant requirements for environment, health and safety; ▪ Excavation should be carried out during dry season as far as possible to minimise contaminated runoff from contaminated soils; ▪ Supply of suitable clean backfill material is needed after excavation; ▪ The chemical oxidant proposed (RegenOxTM) as a	To minimise the potentially adverse environmental impacts arising from the handling of potentially contaminated materials.	Contractor	Sites H and Q /during transportation	Site remediation and prior to construction phase	For Site H: Implemented For Site Q: To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	contaminant mass reduction technology. Comprises a solid oxidant complex (sodium percarbonate/catalytic formulation) and an activator complex (a composition of ferrous salt embedded in a micro-scale catalyst gel). These chemical will be securely stored, separately and way from sources of ignition or oxidizable items. Handling will & will be undertaken by persons specifically trained and wearing appropriate PPE. ▪ Vehicles containing any excavated materials should be suitably covered to limit potential dust emissions or contaminated wastewater run-off, and truck bodies and tailgates should be sealed to prevent any discharge during transport or during wet conditions; ▪ Speed control for the trucks carrying contaminated materials should be enforced; and ▪ Vehicle wheel and body washing facilities at the site's exist points should be established and used.					
S9.35(iv)	In order to minimise the potentially adverse effects on health and safety of construction workers during the course of site remediation, the Occupation Safety and Health Ordinance (OSHO) (Chapter 509) and its subsidiary Regulations should be followed by all site personnel working on the site at all times. In addition, the following basic health and safety measures should be	To minimise the potentially adverse effects on health and safety of construction workers during the course of site remediation	Contractor	Sites H and Q	Site remediation and prior to construction phase	

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	implemented as far as possible: ▪ Set up a list of safety measures for site workers; ▪ Provide written information and training on safety for site workers; ▪ Keep a log-book and plan showing the contaminated zones and clean zones; ▪ Maintain a hygienic working environment; ▪ Avoid dust generation; ▪ Provide face and respiratory protection gear to site workers; ▪ Provide personal protective clothing (e.g. chemical resistant jackboot, liquid tight gloves) to site workers; and ▪ Provide first aid training and materials to site workers.					
9.35(v)	For Areas Feasible or Infeasible for On-Site Inspection and Site Investigation (i) Phase 2 supplementary SI works ▪ Upon site access is granted, site inspection should be carried out to ascertain any contaminative sources and hotspot of contamination within the site. ▪ The sampling and testing schedule as recommended	(i) To identify areas with land contamination concern, report laboratory results and propose remediation measures if necessary. (ii) To ensure remediation works have been undertaken to before	MTR/ Contractor	Areas Infeasible for On-Site Inspection and Site Investigation and WSW	After land resumption and prior to the construction works commencement at respective sites	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	in the approved CAP should then be updated based on respective site situation and the number of sampling locations may be significantly reduced. A revised CAP should then be submitted to EPD for endorsement. ▪ For supplementary CARs and RAP(s), upon completion of SI and laboratory testing, supplementary CARs should be submitted to EPD for endorsement. If contamination is identified, RAP(s) should also be submitted to EPD for endorsement. ▪ The revised CAPs and supplementary CARs and /or RAP(s) should be submitted in separate packages for different works area depending on the schedule of land resumption and the commencement of construction works for each works area. ▪ RR(s) should be submitted to demonstrate completion of remediation works before construction work starts at the site. (ii) WSW ▪ According to WSW EP Condition 3.14, the Project Proponent of the WSW development shall prepare and submit CAR/RAP to EPD within 2 months after commencement of construction of the WSW development and the recommendations in the endorsed CAR/RAP shall be fully implemented before the commencement of any construction	the commencement of any construction works of the Project that may disturb the ground of the south-western portion of the MPV.				

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	works that may disturb the ground of the relevant sites. ▪ This project will ensure that the completion of remediation works before the construction works at contaminated areas start.					
Waste Management Implications (Construction Phase)						
S10.107	Recommendations for good site practices: ▪ Prepare a Waste Management Plan approved by the Engineer/Supervising Officer of the Project based on current practices on construction sites; ▪ Training of site personnel in, site cleanliness, proper waste management and chemical handling procedures; ▪ Provision of sufficient waste disposal points and regular collection of waste; ▪ Appropriate measures to minimize windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers; ▪ Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors; and ▪ Separation of chemical wastes for special handling and appropriate treatment.	To implement good site practice for handling, sorting reuse and recycling of C&D materials	Contractor	All works areas	Construction phase	Implemented
S10.108	Recommendations for waste reduction measures: ▪ Sorting of demolition debris and excavated materials from demolition works to recover	To implement on-site sorting facilitating reuse and recycling of materials	Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	reusable/ recyclable portions (i.e. soil, broken concrete, metal etc.); ▪ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; ▪ Encourage collection of aluminium cans by providing separate labelled bins to enable this waste to be segregated from other general refuse generated by the workforce; ▪ Proper storage and site practices to minimize the potential for damage or contamination of construction materials; ▪ Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste; and ▪ Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedures, including waste reduction, reuse and recycle.	as well as proper disposal of waste				
S10.109	The Contractor should prepare and implement a Waste Management Plan (WMP) as a part of the Environmental Management Plan (EMP) in accordance with ETWB TCW No. 19/2005 which describes the arrangements for avoidance, reuse, recovery, recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the	To keep trace of the generation, minimization, reuse and disposal of C&D materials in the Project	Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	construction activities.					
S10.112	Storage of materials on site may induce adverse environmental impacts if not properly managed, recommendations to minimise the impacts include: ▪ Waste, such as soil, should be handled and stored well to ensure secure containment, thus minimising the potential of pollution; ▪ Maintain and clean storage areas routinely; ▪ Stockpiling area should be provided with covers and water spraying system to prevent materials from wind-blown or being washed away; and ▪ Different locations should be designated to stockpile each material to enhance reuse.	To minimise potential impacts of waste storage and enhance reusable volume	Contractor	All work areas	Construction phase	Implemented
S10.113	Waste hauliers must hold a valid permit for the collection of waste as stipulated in their permits. Removal of waste should be done in a timely manner.	To collect and remove waste generated	Contractor	All work areas	Construction phase	Implemented
S10.114-115	Implementation of trip-ticket system to monitor waste disposal and control fly-tipping. Set up warning signs at vehicular access points reminding drivers of designated disposal sites and penalties of an offence. Installation of close-circuited television at access points	To monitor disposal of waste and control fly-tipping	Contractor	All work areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	of vehicles to monitor and prevent illegal dumping.					
S10.117	Recommendations for excavated materials within works areas: ▪ Several ramps should be used for transportation of different materials as far as practicable (at SSS/ERS site, both soft and hard materials could be generated with the provision of three ramps, each of them can be used for single material for primary separation). Each ramp should be used for transportation of a single material as far as practicable. ▪ If a conveyor system is used, materials should be transported separately on the belts, it is therefore proposed that more than one conveyor belt should be installed if possible. If more than one material is needed to be transported on a single belt, each material should be stockpiled separately once they are removed from the excavation face to the ground and the belt should operate at different times with different materials as far as practicable. ▪ Enclosure should also be provided for the conveyor belt, as far as practicable to minimize the of dust generation. ▪ Different locations should be designated for each material during stockpiling. Stockpiling may be needed when the conveyor system is under	To mitigate and minimize the potential impacts from the storage and transportation of materials within works areas	Contractor	All works areas	Construction Phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	constraint or when the spoil could not be transported away from works area immediately after excavation. Cover should be provided to dusty stockpiles to avoid the materials from being wind-blown or flushed away by water. It is expected that water spraying system should also be equipped to moisten the materials.					
S10.119	Wet spoil generated from TBM construction, construction of bored piles and D-wall should be properly handled before disposal to Taishan and Fill Banks respectively for reuse in other projects. Dry materials should be mixed with the wet spoil or by the use of lime to reduce water content where applicable.	To minimise impacts to disposal outlet from reception of wet spoil	Contractor	All works areas	Construction phase	Implemented
S10.120	Wheelwash facilities should be provided before the trucks leave the works area.	To minimise dust impact	Contractor	All works areas	Construction phase	Implemented
S10.121	The Contractor should ensure the on-site separation from inert portion. The waste delivered to landfill should not contain any free water or have water content more than 70% by weight. The haulier must ensure suitable amount of waste would be loaded on different types of trucks used. A one-week notice should be given to EPD with information on Contractor's name and respective contact details.	To meet the requirement for disposal at landfill	Contractor and Waste haulier	All works areas	Construction phase	Implemented
S10.125	This will generally follow the PNAP 25 in handling of dredged/excavated sediment. The dredged / excavated sediments would be loaded onto barges and transported	To dispose sediment in an authorized and least impacted way	Contractor	All works areas with sediments	Detailed Design and Construction	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	to existing designated disposal sites allocated by the MFC according to their levels of contamination, as presented below: ▪ For Type 1 sediment, the sediments will be excavated/dredged and transport to designated CEDD Facilities, typically at South Cheung Chau and/or Ninepin. ▪ For Type 2 sediment, the sediments will be dredged/excavated and transport to designated CEDD Facilities, typically at East Sha Chau for confined marine disposal. ▪ For Type 3 sediment, it would require special treatment/disposal before confined marine disposal at CEDD Facilities, typically at East Sha Chau. In order to have the least potential of loss of contaminants to the marine environment, containment of the sediments in geosynthetic containers is proposed when transporting the sediment. Field trials are recommended to be undertaken during the detailed design stage to establish the optimum handling method for this approach. The details of the disposal methodology could therefore be confirmed during the detailed design stage, prior to construction.			concern	phase	
S10.126	The basic requirements and procedures for dredged / excavated sediment disposal specified under PNAP 252 shall be followed.	To dispose sediment in an authorized and least impacted way	Contractor	All works areas with sediments concern	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S10.127	The Project Proponent will agree in advance with MFC of CEDD on the site allocation by submitting a Construction & Demolition Material Management Plan. The final disposal sites and arrangement will be determined by the MFC and a dumping permit will be obtained from the DEP prior to the commencement of the dredging and excavation works.	To determine the best handling and disposal option of the sediments.	MTR/ Contractor	All works areas with sediments concern	Detailed Design and Construction phase	Implemented
S10.128	The contractor for the dredging/ excavation works shall apply for the site allocations of marine sediment disposal based on the prior agreement with MFC/CEDD. The contractor shall apply for all necessary permits from relevant authorities for the disposal of dredged / excavated sediment.	To dispose the sediments in an authorized way.	Contractor	All works areas with sediments concern	Construction phase	Implemented
S10.129	If temporary stockpiling of sediments is necessary, the sediment should be covered by tarpaulin and earth bunds or sand bag barriers should be provided on site to prevent leachate from entering the drains and surrounding water bodies. The stockpiling areas should be completely paved or covered by lining avoiding contaminating the soil or groundwater underneath.	To prevent the cross contamination of surrounding soils and water bodies	Contractor	All works areas with sediments concern	Construction phase	Implemented
S10.130	The dredged / excavated sediment should be transported by covering trucks to designated barging points. The barge transporting the sediments to the designated disposal site should be equipped with tight fitting seals to prevent leakage. Besides, the barge should not be filled to a level that would cause overflow of materials or laden water during loading or transportation.	To prevent overflowing of sediments to the surrounding area and water bodies	Contractor	All works areas with sediments concern / trucks / barges	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S10.131	Loading of the dredged / excavated sediment to the barge should be controlled to avoid splashing and overflowing of the sediment slurry to the surrounding water.	To prevent overflowing of sediments to the surrounding area and water bodies	Contractor	Barging points	Construction phase	Implemented
S10.132	In order to minimise the potential odour emissions during the dredging / excavation operation and transportation of the sediment, the dredged / excavated sediment placed on barges should be properly covered as far as practicable. Requirement of the *Air Pollution Ordinance (Construction Dust) Regulation*, where relevant, should be adhered to during the construction phase of the Project.	To minimise dust and odor impacts to surrounding environment	Contractor	All works areas with sediments concern / Barging points	Construction phase	Implemented
S10.134	Workers should wear protective gloves when carrying out the dredging / excavation works. Adequate washing and cleaning facilities should be provided on site.	To minimise the exposure to the contaminated sediments	Contractor	All works areas with sediments concern	Construction phase	Implemented
S10.135	For allocation of sediment disposal site and application of marine dumping permit, another proposal for sampling and chemical testing of the sediment will be prepared and submitted to the EPD for approval following the procedures in PNAP 252. The approved detailed sampling and chemical testing will be carried out prior to the commencement of the dredging/excavation activities to confirm the sediment disposal method. The contamination levels of the marine sediment to be dredged / excavated have to be analysed and recorded. After carrying out the sampling and testing, a Sediment Quality Report (SQR) will be prepared for EPD approval as required under the	To analyse the sediments quality and determine the best disposal option	Contractor	All works areas with sediments concern	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	Dumping at Sea Ordinance to agree and confirm the quantities and extent of the contamination of the sediments prior to the dredging/ construction contract being tendered. The SQR will include the sampling details, the chemical testing results, quality control records, proposed classification and delineation of sediment according to the requirements of the Appendix A of PNAP 252.					
S10.136	If chemical wastes are produced at the construction site, the Contractor would be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the *Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes*. Containers used for storage of chemical waste should : ▪ Be compatible with the chemical wastes being stored, maintained in good condition and securely sealed; ▪ Have a capacity of less than 450 litres unless the specifications have been approved by EPD; and ▪ Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the *Waste Disposal (Chemical Waste) (General) Regulation*.	To properly store the chemical waste within works areas	Contractor	All works areas	Construction phase	Implemented
S10.137	The chemical storage areas should: ▪ Be clearly labelled to indicate corresponding chemical characteristics of the chemical waste and used for storage of chemical waste only;	To prepare appropriate storage areas for chemical waste at works areas	Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Be enclosed on at least 3 sides; ▪ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; ▪ Have adequate ventilation; ▪ Be covered to prevent rainfall from entering; and ▪ Be properly arranged so that incompatible materials are adequately separated.					
S10.138	Lubricants, waste oils and other chemical wastes would be generated during the maintenance of vehicles and mechanical equipments. Used lubricants should be collected and stored in individual containers which are fully labelled in English and Chinese and stored in a designated secure place.	To clearly label the chemical waste at works areas	Contractor	All works areas	Construction phase	Implemented
S10.139	A trip-ticket system should be operated in accordance with the *Waste Disposal (Chemical Waste) (General) Regulation* to monitor all movements of chemical waste. The Contractor should employ a licensed collector to transport and dispose of the chemical wastes, to either the approved CWTC at Tsing Yi, or another licensed facility, in accordance with the *Waste Disposal (Chemical Waste) (General) Regulation*.	To monitor the generation, reuse and disposal of chemical waste	Contractor	All works areas	Construction phase	Implemented
S10.140	General refuse should be stored in enclosed bins or compaction units separate from C&D materials and chemical waste. A reputable waste collector should be	To properly store and separate from other C&D materials for subsequent	Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	employed by the contractor to remove general refuse from the site, separately from C&D materials and chemical wastes.	collection and disposal				
S10.141	The recyclable component of general refuse, such as aluminium cans, paper and cleansed plastic containers should be separated from other waste. Provision and collection of recycling bins for different types of recyclable waste should be set up by the Contractor. The Contractor should also be responsible for arranging recycling companies to collect these materials.	To facilitate recycling of recyclable portions of refuse	Contractor	All works areas	Construction phase	Implemented
S10.142	The Contractor should carry out a training programme for workers in avoiding, reducing, reusing and recycling of materials generation. Posters and leaflets advising on the use of the bins should also be provided in the sites as reminders.	To raise workers' awareness on recycling issue	Contractor	All works areas	Construction phase	Implemented
Waste Management Implications (Operation Phase)						
S10.146-10.147	Chemical waste: ▪ The requirements stipulated in the *Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes* should be followed in handling of chemical waste as in construction phase. ▪ A trip-ticket system should be operated in accordance with the *Waste* Disposal *(Chemical*	To avoid environmental impacts in handling, storage and disposal of chemical waste	MTR	Ventilation buildings, SSS and WKT	Operation phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	Waste) (General) Regulation to monitor all movements of chemical wastes which would be collected by a licensed collector to a licensed facility for final treatment and disposal. ▪ The recommendations proposed for the mitigation of impacts from chemical waste in construction phase should also be followed (refer to S10.104-S10.106).					
S10.148-S10.149	General refuse: ▪ Provide recycling bins at designated areas for proper recycling of papers, aluminium cans and plastics bottles. ▪ Separation from other waste types and collected by licensed collectors at daily basis to minimize the potential impacts from odour and vermin.	To separate general refuse from other waste types and proper disposal of the refuse	MTR	Ventilation buildings, SSS and WKT	Operation phase	To be implemented as per construction programme
S10.150	Industrial waste: ▪ Separation of reusable components like steel before collection by licensed collector	To recycle useful materials from industrial waste and proper disposal	MTR	Ventilation buildings, SSS and WKT	Operation phase	To be implemented as per construction programme
Water Quality Impact (Construction Phase)						

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S11.128 - S11.153	Construction site run-off and general construction activities: ▪ The mitigation measures as outlined in the ProPECC PN 1/94 Construction Site Drainage should be adopted where applicable.	To control water quality impact from construction site runoff and general construction activities	MTR / Contractor	All works areas	Construction phase	Implemented
S11.154	Groundwater seepages from uncontaminated area: ▪ In case seepage of uncontaminated groundwater occurs, groundwater should be pumped out from the works areas and discharged into the storm system via silt removal facilities. Uncontaminated groundwater from dewatering process should also be discharged into the storm system via silt traps.	To control water quality impact from groundwater from uncontaminated area	MTR / Contractor	All works areas	Construction phase	Implemented
S11.155	As the proposed WKT is near the Victoria Harbour, high ground water level regime due to both tidal effects and rainwater infiltration is anticipated. A cofferdam wall should be built to limit groundwater inflow to the excavation works areas in the WKT site.	To control water quality impact from groundwater from uncontaminated area	MTR / Contractor	WKT	Construction phase	Implemented
S11.156	To monitor the tide and groundwater relationship, it is recommended to install groundwater level loggers at the nearest tidal areas (i.e. near Mai Po).	To monitor the groundwater level	MTR / Contractor	Mai Po	Construction phase	Implemented
S11.157 - S11.158	Site Runoff or Groundwater from contaminated areas: ▪ No directly discharge of groundwater from contaminated areas should be adopted.	To control water quality impact from contaminated groundwater	MTR / Contractor	Excavation areas where contaminated	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Prior to any excavation works within the potentially contaminated areas, the baseline groundwater quality in the areas should be reviewed based on the past relevant site investigation data and any additional groundwater quality measurements to be performed with reference to *Guidance Note for Contaminated Land Assessment and Remediation* and the review results should be submitted to EPD for examination. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, this contaminated groundwater should be either properly treated or properly recharged into the ground in compliance with the requirements of the TM-DSS. ▪ If wastewater treatment is to be deployed for treating the contaminated groundwater, the wastewater treatment unit shall deploy suitable treatment processes (e.g. oil interceptor / activated carbon) to reduce the pollution level to an acceptable standard and remove any prohibited substances (such as TPH) to an undetectable range. ▪ All treated effluent from the wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be either discharged into the foul sewers or tankered away for proper disposal. ▪ If deployment of wastewater treatment is not feasible for handling the contaminated			ground-water is found		

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	groundwater, groundwater recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in section 2.3 of the TM-DSS. The baseline groundwater quality should be determined prior to the selection of the recharge wells, and submit a working plan to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Groundwater monitoring wells should be installed near the recharge points to monitor the effectiveness of the recharge wells and to ensure that no likelihood of increase of groundwater level and transfer of pollutants beyond the site boundary. Prior to recharge, free products should be removed as necessary by installing the petrol interceptor. The Contractor should apply for a discharge licence under the WPCO through the Regional Office of EPD for groundwater recharge operation or discharge of treated groundwater.					
S11.128 - S11.136,	Barging points: Mitigation measures for control water quality impact from surface run-off should be applied.	To control water quality impact from barging point	MTR / Contractor	All barging Points	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S11.160	The following good site practices should also be adopted: ▪ all vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash ▪ all hopper barges should be fitted with tight fitting seals to their bottom openings to prevent leakage of material ▪ construction activities should not cause foam, oil, grease, scum, litter or other objectionable matter to be present on the water within the site ▪ loading of barges and hoppers should be controlled to prevent splashing of material into the surrounding water. Barges or hoppers should not be filled to a level that will cause the overflow of materials or polluted water during loading or transportation					
S11.161	Effluent discharge: There is a need to apply to EPD for a discharge licence for discharge of effluent from the construction site under the WPCO. The discharge quality should meet the requirements specified in the discharge licence. Minimum distances of 100 m should be maintained between the discharge points of construction site effluent and the existing seawater intakes. If	To control water quality impact from effluent discharge from construction site	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	monitoring of the treated effluent quality from the works areas is required during the construction phase of the Project, the monitoring should be carried out in accordance with the WPCO license which is under the ambit of regional office (RO) of EPD.					
S11.162	Accidental spillage of chemicals: Contractor should register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes**.**	To control water quality impact from accidental chemical spillage	MTR / Contractor	All works areas	Construction phase	Implemented
S11.163	Any service shop and maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges.	To control water quality impact from accidental chemical spillage	MTR / Contractor	All works areas	Construction phase	Implemented
S11.164	Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows:	To control water quality impact from accidental chemical spillage	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport. ▪ Chemical waste containers should be suitably labelled, to notify and warn the personnel who are handling the wastes, to avoid accidents. ▪ Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area.					
S11.165	Surface construction works at or in close proximity of watercourses or seafront: ▪ The proposed surface construction works should be carried out in dry season as far as practicable where the flow in the river channel or stream is low. ▪ The use of less or smaller construction plants may be specified to reduce the disturbance to the riverbed or pond deposits. ▪ Temporary sewerage system should be designed to prevent wastewater from entering the river, streams and sea. ▪ Temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction materials should be located well away from any water courses during carrying out of the construction works.	To control water quality impact from construction works at or in close proximity of watercourses or seafront	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Stockpiling of construction materials and dusty materials should be covered and located away from any water courses. ▪ Construction debris and spoil should be covered up and/or disposed of as soon as possible to avoid being washed into the nearby water receivers. ▪ Construction activities, which generate large amount of wastewater, should be carried out in a distance away from the waterfront, where practicable. ▪ Mitigation measures to control site run-off from entering the nearby water environment should be implemented to minimize water quality impacts. Surface channels should be provided along the edge of the waterfront within the work sites to intercept the run-off. ▪ Construction effluent, site run-off and sewage should be properly collected and/or treated. ▪ Any works site inside the water courses should be temporarily isolated. The water flow should be temporarily diverted to downstream by using PVC pipes, steel arrays in concrete case or similar, restricting the excavation works to be conducted within an enclosed dry section of the channel. This works arrangement would provide a dry zone for excavation works within the river channel and would prevent the conveyance of suspended					

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	sediment downstream. Dewatering at works section should be conducted prior to the commencement of works. Further limiting or reducing the works area inside the water courses should be considered during wet season or rainstorm event in order to reduce the area of exposed surface. ▪ Silt curtain should be installed around the construction activities at or near the watercourses to minimize the potential impacts due to accidental spillage of construction wastes and excavated materials. ▪ Proper shoring may need to be erected in order to prevent soil or mud from slipping into the watercourses. ▪ Supervisory staff should be assigned to station on site to closely supervise and monitor the works.					
S11.166	Surface construction works close to water gathering grounds: ▪ The conditions as specified in WSD guidelines on protection of Water Gathering Ground should be followed or observed where practicable	To control water quality impact from surface construction works close to Water Gathering Ground	MTR / Contractor	Works areas close to water gathering ground	Construction phase	To be implemented as per construction programme
S11.167	Dredging of marine sediments at LKST: ▪ Closed grab dredger should be used to minimize the loss of sediment during the raising of the loaded	To minimize the loss of fine sediment to suspension during	MTR / Contractor	Marine dredging at LKST	Construction phase	To be implemented as per

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	grabs through the water column. ▪ No more than one closed grab dredger should be operated at any one time. ▪ Double silt curtains should be deployed around the dredging operations as far as practicable. ▪ The descent speed of grabs should be controlled to minimize the seabed impact speed. ▪ Barges should be loaded carefully to avoid splashing of material. ▪ All barges used for the transport of dredged materials should be fitted with tight bottom seals in order to prevent leakage of material during loading and transport. ▪ All barges should be filled to a level which ensures that material does not spill over during loading and transport to the disposal site and that adequate freeboard is maintained to ensure that the decks are not washed by wave action.	dredging of marine sediments at LKST				construction programme
S11.83 and S11.165	Diversion of watercourse: ▪ The excavation works at the existing stream in Shek Kong/ Kam Tin Nullah should be carried out by approved methods by the Engineer to minimise erosion. Should excavation works be carried out at the designated section of water course, temporary river diversion should be conducted prior to the commencement of works to avoid water flowing	To control water quality impact due to diversion of watercourse	MTR / Contractor	Watercourse to be diverted in Shek Kong	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	into works area. The temporary diversion of water flow should be performed by appropriate means, such as completing the construction of the proposed channel section for carrying diverted flow prior to excavation works, or other similar methods, as approved by the Engineer to suit the works condition. This works arrangement would provide a dry zone for excavation works within the river channel and would prevent the conveyance of suspended sediment downstream. Dewatering at works section should also be conducted prior to the commencement of works. ▪ Mitigation measures for minimizing the water quality impact for surface construction works at or close to the watercourses should also be applied.					
S. 11.169 - 11.173	Hydrogeological Impact: For the cut and cover tunnels and associated excavations for vent buildings and emergency access/escape points, the following measures should be in place in order to mitigate any drawdown effects to the groundwater table during the operation of the temporary dewatering works: ▪ Toe grouting should be applied beneath the toe level of the temporary/permanent cofferdam walls as necessary to lengthen the effective flow path of groundwater from outside and thus control the amount of water inflow to the excavation.	To control groundwater hydrogeological impact and groundwater drawdown	MTR/ Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Recharge wells should be installed as necessary outside the excavation areas. Water pumped from the excavation areas should be recharge back into the ground. The bored tunnels should be constructed using a closed face tunnel boring machine to limit water inflow into the excavation face. The cutter head for the machine will be sealed during excavation and therefore the water inflow from the face will be very small. Precast undrained linings should be installed and back grouted behind the tunnel boring machine as it advances along the alignment to minimize the potential inflow of water behind the cutter head. The Contractor should initially adopt suitable water control strategies while undertaking the excavation works. The water control strategies are shown as follow: ▪ Probing Ahead: As normal practice, the Contractor will undertake rigorous probing of the ground ahead of tunnel excavation works to identify zones of significant water inflow. The probe drilling results will be evaluated to determine specific grouting requirements in line with the tunnel advance. In such zones of significant water inflow that could occur as a result of discrete, permeable features, the intent would be to reduce overall					

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	inflow by means of cut-off grouting executed ahead of the tunnel advance. ▪ Pre-grouting: Where water inflow quantities are excessive, pre-grouting will be required to reduce the water inflow into the tunnel. The pre-grouting will be achieved via a systematic and carefully specified protocol of grouting. ▪ In principle, the grout pre-treatment would be designed on the basis of probe hole drilling ahead of the tunnel face. In the event of excessive drawdown being observed within the ground water table as a result of the tunnelling works even after incorporation of the water control strategies, post-grouting will be applied as described below: ▪ Post-grouting: Groundwater drawdown will be most likely due to inflows of water into the tunnel that have not been sufficiently controlled by the pre-grouting measures. Where this occurs post grouting will be undertaken before the lining is cast. Whilst unlikely to be required in significant measure, such a contingency should be allowed for reduction in permeability of the tunnel surround (by grouting) to limit inflow to acceptable levels.					

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	A detailed groundwater monitoring programme should be developed in detailed design stage to monitor both the proposed works and the impact of those works on the adjacent area.					
Water Quality Impact (Operation Phase)						
S11.174	Tunnel run-off and drainage: ▪ Track drainage channels discharge should pass through oil/grit interceptors/chambers to remove oil, grease and sediment before being pumped to the foul sewer/holding tank for further disposal. ▪ The silt traps and oil interceptors should be cleaned and maintained regularly. ▪ Oily contents of the oil interceptors should be transferred to an appropriate disposal facility, or to be collected for reuse, if possible.	To control runoff from rail track	MTR / DDC	Tunnels and rail tracks	Operation phase	To be implemented as per construction programme
S11.175 – S11.176	Sewage effluents: ▪ Connection of domestic sewage generated from the Project should be diverted to the foul sewer wherever possible. If public sewer system is not available, sewage tanking away services or on-site sewage treatment facilities should be provided to prevent direct discharge of sewage to the nearby storm system and all the discharge should comply with the requirements stipulated in the TM-DSS. ▪ For handling, treatment and disposal of other	To control water quality impact from sewage effluent discharge ventilation buildings, SSS and WKT	MTR / DDC	Ventilation buildings, SSS and WKT	Operation phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	operation stage effluent, the practices outlined in ProPECC PN 5/93 should be adopted where applicable.					
S11.177-S11.181	Shek Kong Stabling Sidings (SSS): ▪ All the maintenance areas within the SSS should be housed or covered to prevent generation of contaminated rainwater runoff. All wastewater generated from the maintenance and cleaning activities should be collected and diverted to oil interceptor or other appropriate treatment facilities for proper treatment so that it satisfies the requirements stipulated in the TM-DSS. ▪ In case there is no pubic sewer available for the SSS during the operation phase, all wastewater generated or collected in the SSS should be tankered away for proper disposal to prevent direct discharge of any wastewater to the nearby surface water system. ▪ Oil interceptors should be regularly inspected and cleaned to avoid wash-out of oil during storm conditions. A bypass would be provided to avoid overload of the interceptor's capacity. ▪ All waste oils and fuels should be collected and handled in compliance with the Waste Disposal Ordinance. Site drainage should be well maintained and good management practices should be observed to ensure that oils and chemicals are managed,	To control water quality impacts from the operation of Shek Kong Stabling Sidings	MTR/DDC	SSS	Operation phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	stored and handled properly and do not enter the nearby water streams. Areas for chemical storage should be securely locked. The storage area should have an impermeable floor and bunding of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest, to minimize the impacts from any potential accidents. In case of the occurrence of accidental spillage of chemicals, it is required to take immediate actions to control the release of chemicals. ▪ Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes.					
S11.182	For any future maintenance desilting of the newly constructed or diverted watercourses, temporary barrier walls should be used to provide a dry zone for desilting work. Maintenance desilting should be carried out during periods of low flow in the dry season.	To control water quality impact due to maintenance desilting of the newly constructed or diverted watercourses	MTR	Diverted watercourses in Shek Kong	Operation phase	To be implemented as per construction programme
Air Quality (Construction Phase)						
S 12.78	For concrete batching plant, the requirements and mitigation measures stipulated in the *Guidance Note on*	To minimize dust impacts	MTR /	Concrete batching plant	Construction	To be implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	the Best Practicable Means for Cement Works (Concrete Batching Plant) BPM 3/2(93) should be followed and implemented.		Contractor	at works area V	phase	as per construction programme
Table 12.9 and Table 12.12	The design emission concentration of dust collector for different types of silos for concrete batching plant should be: ▪ Dust collector for each small Cement Silo ≤ 30 mg/m^3 ▪ Dust collector for each Large Capacity Cement Silo ≤ 50mg/m^3 ▪ Dust collector for each PFA Silo ≤ 30 mg/m^3 ▪ Dust collector for each Mixer ≤ 40 mg/m3 During operation of concrete batching plant: ▪ The aggregates should be unloaded from the tipper trucks to the receiving hopper equipped with enclosures on 3 sides and top cover, and water spraying system. ▪ The cement and PFA should be directly loaded into the silo via a flexible duct. Dust collectors should be installed at the cement/PFA silo based on the above design emission rates. ▪ The aggregates should be stored in fully enclosed overhead storage bins. The top of overhead	To minimize dust impacts	MTR / Contractor	Concrete batching plant at works area V	Construction phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	storage bins should be covered with cladding. Water spraying system should be installed at the top of storage bins for watering the aggregates, and aggregate storage bins should be fully enclosed. ▪ The whole process of weighing and mixing of cementitious material should be performed in a fully enclosed environment. The mixers shall equip with the dust collectors based on the above design emission rates. ▪ The concrete should be directly loaded from the mixer into the transit mixer of a truck in "wet" form. ▪ Haul road within the site should be paved. Wheel washing pit should be installed at the gate of the concrete batching plant. Water spraying system should be installed along the haul road.					
Table 12.10	(1) Cut & Cover Areas and Stockpiles in the vicinity of adits/shafts: (a) Heavy construction activities at Cut & Cover Areas, Storage of materials at Stockpiles - Active areas for heavy construction activities, loading & unloading materials at stockpiles ▪ The specified requirements for cut & cover areas and stockpiles at Shek Kong, Nam Cheong and West Kowloon works areas are as follows:	To minimize dust impacts	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	(i) Shek Kong works area – active area minimized to 15% of total area, watering with complete coverage of active area ten times a day. (ii) Nam Cheong works area – active area minimized to 30% of total area, watering with complete coverage of active stockpile area four times a day. (iii) West Kowloon works area – active area minimized to 15% of total area, watering with complete coverage of active area eight times a day. ▪ For other sites, the active area would be minimized to 30% of the total area, water spraying system would be applied on the active area and watering with complete coverage of active area four times a day would be required. ▪ The remaining inactive area would be well covered with impervious sheeting at all work sites. (b) Trucks - Transportation of materials ▪ Wheel wash facilities provided at the site exit. The vehicles should be washed before leaving the stockpiles. The spoils should also be well covered before leaving the site in order to minimise generation of dusty materials.					

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ The haul roads within the site should be paved and water spraying would be provided to keep the wet condition. ▪ For the Shek Kong works area, watering paved haul roads once per hour would be provided. (2) Temporary stockpiles within barging facilities: (a) Loading point - Loading of spoils from trucks onto stockpile ▪ Water spraying should be provided at the loading points to suppress the dust impact. (b) Storage of materials - Active area for loading & unloading materials ▪ Water spraying system should be applied on the active area and watering with complete coverage of active area four times a day is required.					
Table 12.11	Barging facilities: (1) Haul road within barging facilities - Transportation of spoils to the barging points ▪ All road surfaces within the barging facilities should be paved and water spraying should be provided to keep the wet condition. For paved haul roads at West Kowloon and Nam Cheong, watering haul road once per hour is required.	To minimize dust impacts	MTR / Contractor	All barging points	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	(2) Unloading of materials - Unloading of spoil materials ▪ The unloading process should be undertaken within enclosed tipping hall. Water spraying and dust curtain should be provided at the discharge point for dust suppression. (3) Trucks - Vehicles leaving the barging facilities ▪ Vehicle wheel washing facilities should be provided at site exit. (4) Transportation of spoils to one of the Nam Cheong Barging Point ▪ Fully enclosed conveyor system should be adopted for transportation of spoils from shaft to the barging point.					
S 12.78	Dust suppression measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices: ▪ Use of regular watering, with complete coverage, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather. ▪ Use of frequent watering for particularly dusty construction areas and areas close to ASRs. ▪ Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions.	To minimize dust impacts	MTR / Contractor	All works areas	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	Where this is not practicable owing to frequent usage, watering should be applied to aggregate fines. ▪ Open stockpiles should be avoided or covered. Where possible, prevent placing dusty material storage piles near ASRs. ▪ Tarpaulin covering of all dusty vehicle loads transported to, from and between site locations. ▪ Establishment and use of vehicle wheel and body washing facilities at the exit points of the site. ▪ Provision of wind shield and dust extraction units or similar dust mitigation measures at the loading points, and use of water sprinklers at the loading area where dust generation is likely during the loading process of loose material, particularly in dry seasons/ periods. ▪ Imposition of speed controls for vehicles on unpaved site roads. 8 kilometers per hour is the recommended limit. ▪ Where possible, routing of vehicles and positioning of construction plant should be at the maximum possible distance from ASRs. ▪ Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides.					

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	▪ Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed. ▪ Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system.					
S12.94	Environmental monitoring and audit for dust emission should be conducted in accordance with EM&A Manual during the construction phase of the Project to check compliance with legislative requirements.	To monitor dust impact	MTR / Contactor	Proposed monitoring locations	Design and operation phases	Implemented
Air Quality (Operation Phase)						
S12.48	The vent shafts of the stations should be designed to be sited at more than 5m from any opening at the adjacent building	To alleviate the adverse air quality impact in the stations	MTR	WKT	Design and operation phases	To be implemented as per construction programme
S12.50	The design of the mechanical air ventilation for PTI should follow EPD's ProPECC PN1/98 Control of Air Pollution in Semi-confined Public Transport Interchanges.	To alleviate the adverse air quality impact in the PTI	MTR	PTI at the ground floor of ventilation building	Design and operation phases	To be implemented as per construction

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
				complex at WKT		programme
Hazard to Life						
S13.96/ S13.99	Improved truck design to reduce the amount of combustibles in the cabin and fuel carried in the fuel tank should be minimised to reduce the duration of any fire. The truck should be brand new, diesel powered and equipped with fuel and battery isolation switches, front exhaust spark arrester, 1 x 9 kg water based and 1 x 9 kg dry chemical powder fire extinguishers. This should be combined with monthly vehicle inspection	To meet the ALARP requirement	MTRC/ Contractor	-	Construction phase	Implemented
S13.96	The explosive truck accident frequency should be minimized by implementing a dedicated training programme for both the driver and his attendants, including regular briefing sessions, implementation of a defensive driving attitude. In addition, drivers should be selected based on good safety record, and medical checks.	To meet the ALARP requirement	MTRC/ Contractor	-	Construction phase.	Implemented
S13.96	The contractor should as far as practicable combine the explosive deliveries for a given work area.	To meet the ALARP requirement	MTRC/ Contractor	-	Construction phase	Implemented
S13.96	The explosive truck fire involvement frequency should be minimized by implementing a better emergency response	To meet the ALARP	MTRC/	-	Construction	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	and training to make sure the adequate fire extinguishers are used and attempt is made to evacuate the area of the incident or securing the explosive load if possible. All explosive vehicles should also be equipped with bigger capacity AFFF-type extinguishers.	requirement	Contractor		phase	
S13.96	A minimum headway between two consecutive truck conveys of at least 10 min is recommended	To meet the ALARP requirement	MTRC/ Contractor	Along explosives transport route.	Construction phase.	Implemented
S13.96/ S13.105	Only the required quantity of explosives for a particular blast should be transported to avoid the return of unused explosives to the magazines. If disposal is required for small quantities, disposal should be made in a controlled and safe manner by a Registered Shotfirer.	To reduce the risk during explosives transport	MTRC/ Contractor	-	Construction phase	Implemented
S13.97	Blasting activities including storage and transport of explosives should be supervised and audited by competent site staff to ensure strict compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives storage and transport would be acceptable	MTRC / Contractor	Works areas at which explosives would be stored and/or	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
				used.		
S13.97	Emergency plan (ie magazine operational manual) shall be developed to address uncontrolled fire in magazine area and transport. The case of fire near an explosive carrying truck in jammed traffic should also be covered. Drill of the emergency plan should be carried out at regular intervals.	To reduce the risk of fire	MTRC/ Contractor	Explosive Magazine and along explosives transport route.	Construction phase	Implemented
S13.97	Adverse weather working guideline should be developed to clearly define procedure for transport explosives during thunderstorm.	To ensure safe transport of explosives	MTRC/ Contractor	Along explosives transport route.	Construction phase	Implemented
S13.98	Delivery vehicles shall not be permitted to remain within the secured fenced off magazine store area.	To reduce the risk of fire within the magazine	MTRC / Contractor	Explosive Magazine	Construction phase	Implemented
S13.98	Good house-keeping within and outside of the magazine to ensure that combustible materials (including vegetation) are removed and not allowed to accumulate.	To reduce the risk of fire within the magazine	MTRC / Contractor	Explosive Magazine	Construction phase	Implemented
S13.99/ S13.101	Use only experienced driver(s) with good safety record. Training should be provided to ensure it covers all major safety subjects.	To ensure safe transport of explosives	MTRC/ Contractor	-	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
S13.99	Develop procedure to ensure that parking space on the site is available for the explosive truck. Confirmation of parking space should be communicated to truck drivers before delivery.	To ensure that the risks from the proposed explosives storage and transport would be acceptable	MTRC/ Contractor	Explosive magazine	Construction phase	Implemented
S13.99	Detonators shall not be transported in the same vehicle with other Class 1 explosives	To reduce the risk of explosion during the transport of cartridge emulsion	MTRC / Contractor	-	Construction phase	Implemented
S13.99	During transport of the explosives within the tunnel, hot work should not be permitted in the vicinity of the explosives offloading or charging activities.	To ensure safe transport of explosives	MTRC/ Contractor	Along explosives transport route.	Construction phase	Implemented
S13.99	Ensure that packaging of detonators remains intact until handed over at blasting site.	To reduce the risk of explosion during the transport of detonator	MTRC/ Contractor	-	Construction phase	Implemented
S13.99	Horizontal fire screen on cargo deck and vertical fire screen mounted at least 150 mm behind the drivers cab and 100 mm from the steel cargo compartment, the vertical screen shall protrude 150 mm in excess of all three	To reduce the risk during explosives transport	MTRC/ Contractor	-	Construction phase	Implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	(3) sides of the steel cargo compartment.					
S13.104	Ensure that cartridge emulsion with high water content should be preferred. Also, the emulsion with perchlorate formulation should be avoided.	To ensure safe explosives to be used	MTRC/ Contractor	-	Construction phase	Implemented
Landfill Gas Hazard – Design and Construction Phases						
S14.73 & S14.86	- All personnel who work on site and all visitors to the site should be made aware of the possibility of ignition of gas in the vicinity of excavations. Safety notices should be posted warning of the potential hazards.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone, Barging Point and Nursery Site	Construction phase	To be implemented as per construction programme
S14.73	- Those staff who work in, or have responsibility for "at risk" areas, including all excavation workers, supervisors and engineers working within the Consultation Zone, should receive appropriate training on working in areas susceptible to landfill gas, fire and explosion hazards.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme
S14.73	- During all works, safety procedures will be implemented to minimise the risks of fires and	Protect the workers from	Contractor	XRL tunnels within the	Construction	To be implemented

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	explosions and asphyxiation of workers (especially in confined space).	landfill gas hazards		NTML Consultation Zone	phase	as per construction programme
S14.73	- Safety officers, specifically trained with regard to landfill gas related hazards and the appropriate actions to take in adverse circumstances will be present on all worksites throughout the works.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme
S14.73, S14.86, S14.87	- Smoking and naked flames will be prohibited within confined spaces. 'No Smoking' and 'No Naked Flame' notices in Chinese and English will be posted prominently around the construction site. Safety notices should be posted warning of the potential hazards.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone, Barging Point and Nursery Site	Construction phase	To be implemented as per construction programme
S14.73	- Welding, flame-cutting or other hot works may only be carried out in confined spaces when controlled by a 'permit to work' procedure, properly authorised by the Safety Officer. The permit to work procedure will set down clearly the requirements for continuous	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	monitoring of methane, carbon dioxide and oxygen throughout the period during which the hot works are in progress. The procedure will also require the presence of an appropriately qualified person who shall be responsible for reviewing the gas measurements as they are made, and who shall have executive responsibility for suspending the work in the event of unacceptable or hazardous conditions. Only those workers who are appropriately trained and fully aware of the potentially hazardous conditions which may arise will be permitted to carry out hot works in confined areas.					
S14.73	- A mechanical ventilation system must be in use at all times during which personnel are engaged in works inside the tunnel or excavation and be evacuated in the event of power outages. Work must not be carried out in the absence of mechanical ventilation and supervision of adequately trained safety personnel. In exceptional case where work is carried out under non-ventilated condition, any electrical equipment used, such as motors and	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	extension cords, should be intrinsically safe.					
S14.73	- Adequate fire extinguishing equipment, fire-resistant clothing and breathing apparatus sets should be made available on site.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme
S14.86	- Raising the site office 500mm above ground.	Protect the workers from landfill gas hazards	Contractor	Barging Point	Construction phase	Implemented
S14.86	- Utilities services connected to the site office and the annulus around these service entry points should be properly sealed.	Protect the workers from landfill gas hazards	Contractor	Barging Point	Construction phase	Implemented
S14.74	- Construction works to be undertaken in confined space should follow the relevant Regulations under Chapter 59 Factories and Industrial Undertakings Ordinance and Chapter 509 Occupational Health and Safety Ordinance.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme
S14.73	- Monitoring of methane, carbon dioxide and oxygen inside the XRL tunnels.	Protect the workers from landfill gas hazards	Contractor	XRL tunnels within the NTML Consultation	Construction phase	To be implemented as per construction

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
				Zone		programme
S14.75	- A walkover survey to monitor flammable gas at all joints and cracks, if identified, upon completion of the tunnel work. Rectifications, such as sealing of cracks and inspection of tunnel seals, shall be carried out for any signs of the presence of flammable gas. The survey should be conducted under non-ventilated condition and before starting the work of the day.	Confirm no landfill gas ingress into the XRL tunnels	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme
S14.76	- Weekly monitoring of methane, carbon dioxide and oxygen in the form of a walkover survey at 20m intervals for section of tunnels under NTML and 50m interval within the NTML Consultation Zone should be conducted after completion of the tunnel construction works and not less than 3 months before commencement of operation. The survey should be conducted under non-ventilated condition and before starting the work of the day.	Confirm no landfill gas ingress into the XRL tunnels	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme
S14.77	- A summary of the monitoring results should be submitted to EPD for record before the commencement of operational phase. The results should be reviewed and agreed with EPD before the	To review and agree the monitoring requirement during the operational phase	MTR/ Contractor	-	Before operation	To be implemented as per construction

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	commencement of operation to determine the monitoring requirements during the operational phase					programme
S14.78	- Appropriate sealant will be applied to joints to prevent the ingress of groundwater, which will also form a low permeability gas barrier. Good workmanship and adequate construction supervision will be required to ensure the actual works are implemented as per the design requirements. This will be implemented by MTRC's Material and Workmanship Specification.	Protect the XRL tunnels from landfill gas hazards	Design Engineer/ Contractor	XRL tunnels within the NTML Consultation Zone	Design and Construction phases	To be implemented as per construction programme
S14.79	- Adequate ventilation will be needed as part of the tunnel design to act as an active gas control when needed.	Protect the XRL tunnels from landfill gas hazards	Design Engineer	XRL tunnels within the NTML Consultation Zone	Design phase	To be implemented as per construction programme
S14.80	- Upon completion of the landfill gas protection measures, a report on the implemented landfill gas protection measures with relevant as-built drawings and other detailed information showing that the design measures mentioned in this assessment to protect the tunnels from landfill gas hazard have been	Ensure landfill gas protection measures have been completed	Contractor	XRL tunnels within the NTML Consultation Zone	Construction phase	To be implemented as per construction programme


EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	properly incorporated should be submitted to EPD.					
Landfill Gas Hazard – Operation Phase						
S14.76	- Ventilation of the tunnels should be switched on for half an hour before the first train is expected (the requirement to implement this measure is subject to findings of the review of landfill gas monitoring data with EPD before the commencement of operation).	Protect the operation of the XRL from landfill gas hazards	MTR	XRL tunnels within the NTML Consultation Zone	Operation phase	To be implemented as per construction programme
S14.76	- All maintenance personnel and station staff working within the tunnels should be educated in the dangers of landfill gas and the signs and symptoms of asphyxia.	Protect the workers from landfill gas hazards	MTR	XRL tunnels within the NTML Consultation Zone	Operation phase	To be implemented as per construction programme
S14.76	- Smoking within the tunnels should be prohibited at all times.	Protect the operation of the XRL and workers from landfill gas hazards	MTR	XRL tunnels within the NTML Consultation Zone	Operation phase	To be implemented as per construction programme
S14.76	- An assumed presence of landfill gas should be adopted at all times by maintenance workers and a strictly regulated “work permit procedure” involving training, ventilation, gas monitoring (as detailed in	Protect the workers from landfill gas hazards	MTR	XRL tunnels within the NTML Consultation	Operation phase	To be implemented as per construction


EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	the Construction recommendations section), safety tracking and communication with maintenance staff, enforcement of the no smoking order.			Zone		programme
S14.82 & S14.83	- The monitoring requirement during the operational phase should be discussed with EPD before the commencement of operation. Weekly monitoring of methane, carbon dioxide and oxygen in the form of a walkover survey at 20m intervals for section of tunnels under NTML and 50m interval within the NTML Consultation Zone is tentatively proposed. The survey should be conducted under non-ventilated condition and before the first train operates and start-up of ventilation, if applicable. A summary of the monitoring results should be submitted to EPD for record at the end of the monitoring period.	Confirm no landfill gas ingress into the XRL tunnels	MTR	XRL tunnels within the NTML Consultation Zone	Operation phase	To be implemented as per construction programme
S14.84	- An annual walkover survey in the tunnels within the Consultation Zone of the NTML should be conducted to test for the presence of flammable gas at joints and cracks, if identified. Rectifications, such as sealing of cracks and inspection of tunnel seals, should be carried out for any signs of presence of flammable	Confirm no landfill gas ingress into the XRL tunnels	MTR	XRL tunnels within the NTML Consultation Zone	Operation phase	To be implemented as per construction programme


EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status
	gas. The survey should be conducted under non-ventilated condition and before the first train operates and start-up of ventilation, if applicable.					


Appendix D


Monitoring Locations

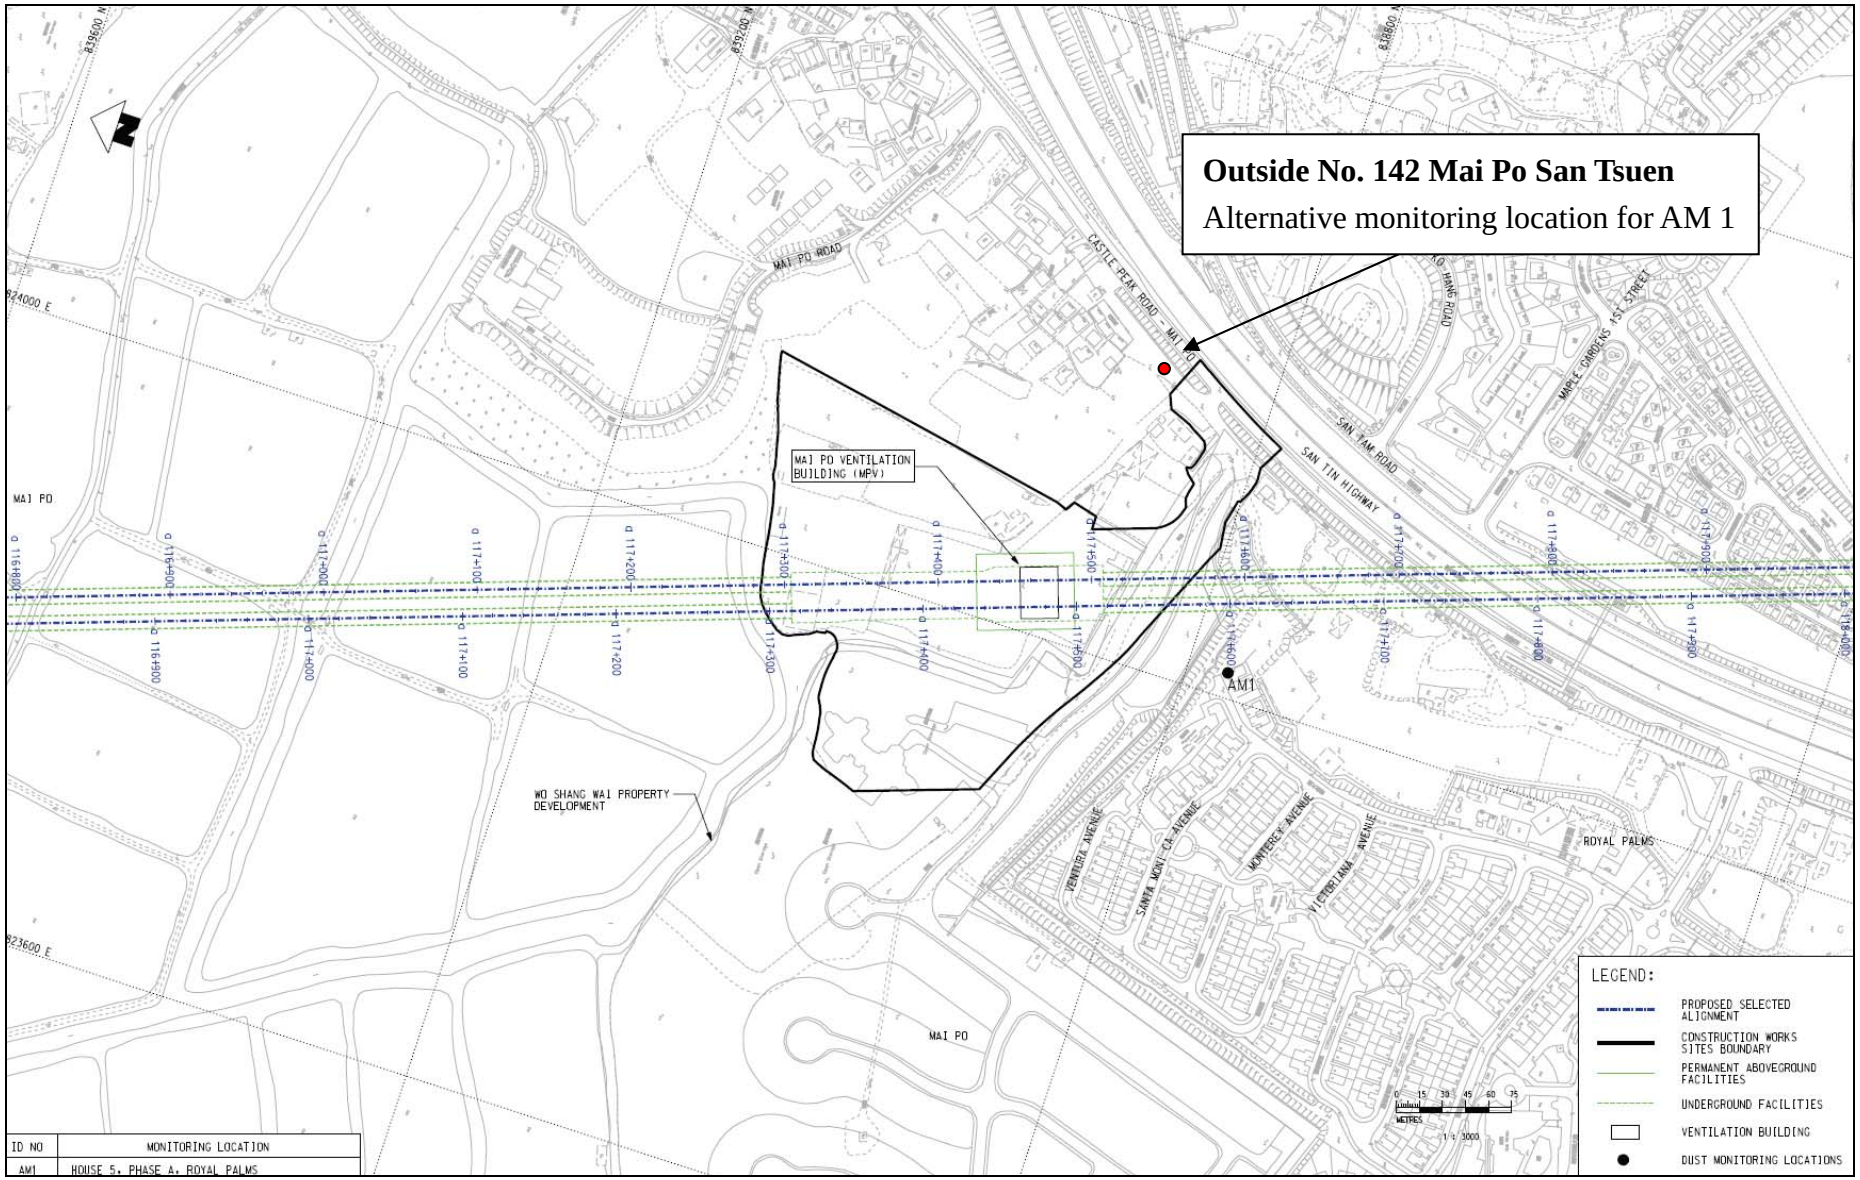
Outside No. 142 Mai Po San Tsuen
Alternative monitoring location for AM 1
MAI PO VENTILATION BUILDING (MPV)
WO SHANG WAI PROPERTY DEVELOPMENT
AM1
MAI PO
MAI PO ROAD
CASTLE PEAK ROAD - MAI PO
SAN TIN HIGHWAY
SAN TAM ROAD
ROYAL PALMS
VENTURA AVENUE
SANTA MONICA AVENUE
MONTEREY AVENUE
VICTORIANA AVENUE
MARIE CURIENS 1ST STREET
839600 N
824000 E
823600 E
ID NO
MONITORING LOCATION
AM1
HOUSE 5, PHASE 4, ROYAL PALMS
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
DUST MONITORING LOCATIONS
METRES
1 : 3000

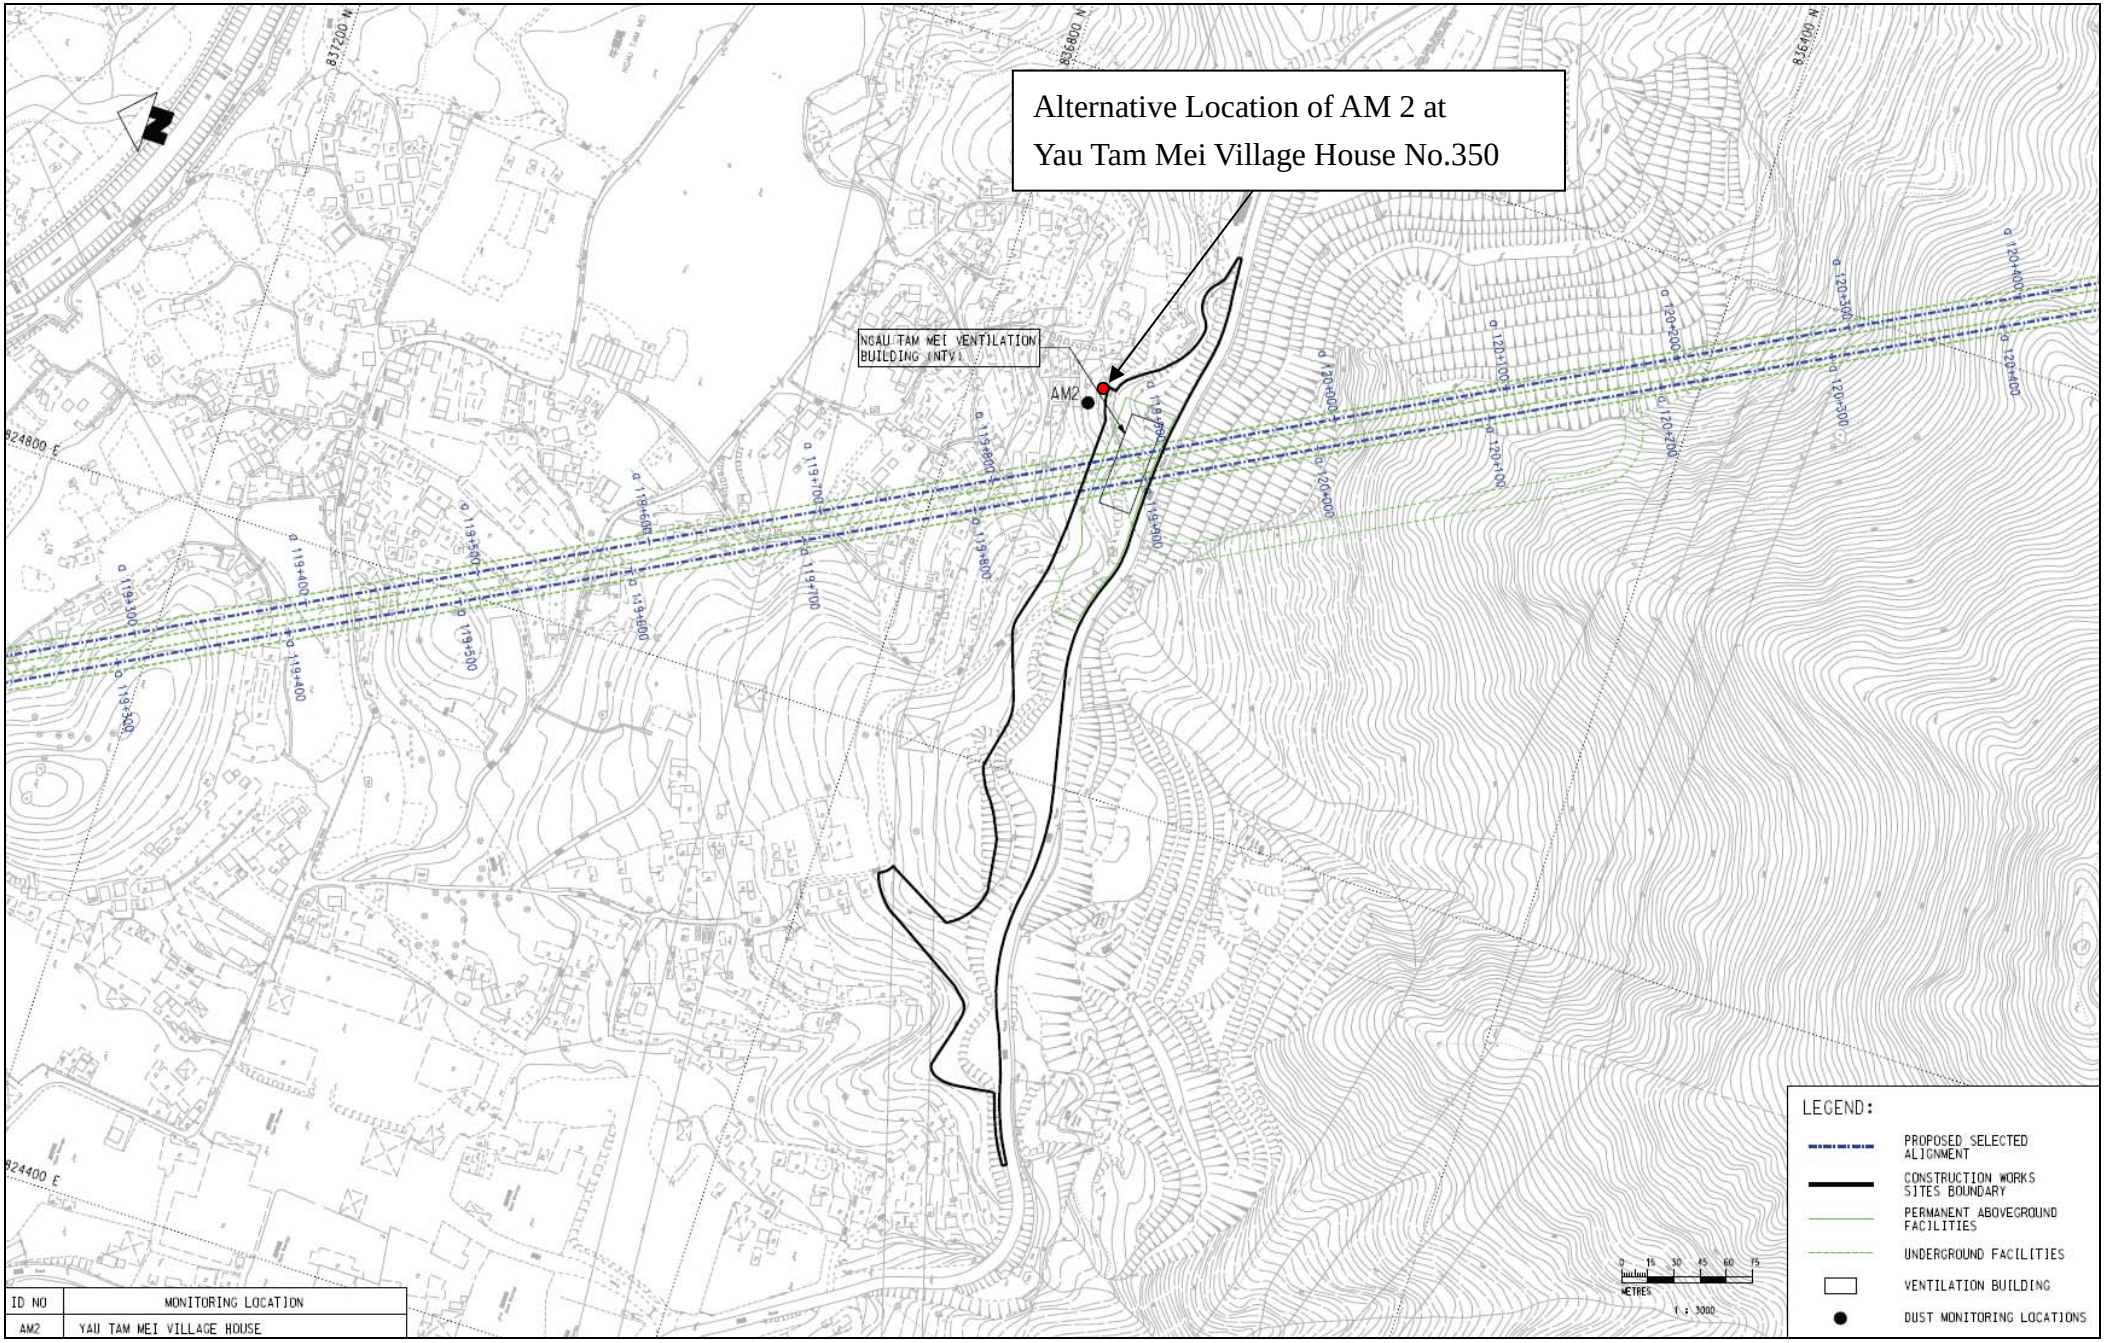

Alternative Location of AM 2 at
Yau Tam Mei Village House No.350
NGAU TAM MEI VENTILATION BUILDING (NTV)
AM2
837200 N
836800 N
836400 N
824800 E
824400 E
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
DUST MONITORING LOCATIONS
METRES
1 : 3000
ID NO | MONITORING LOCATION
AM2 | YAU TAM MEI VILLAGE HOUSE

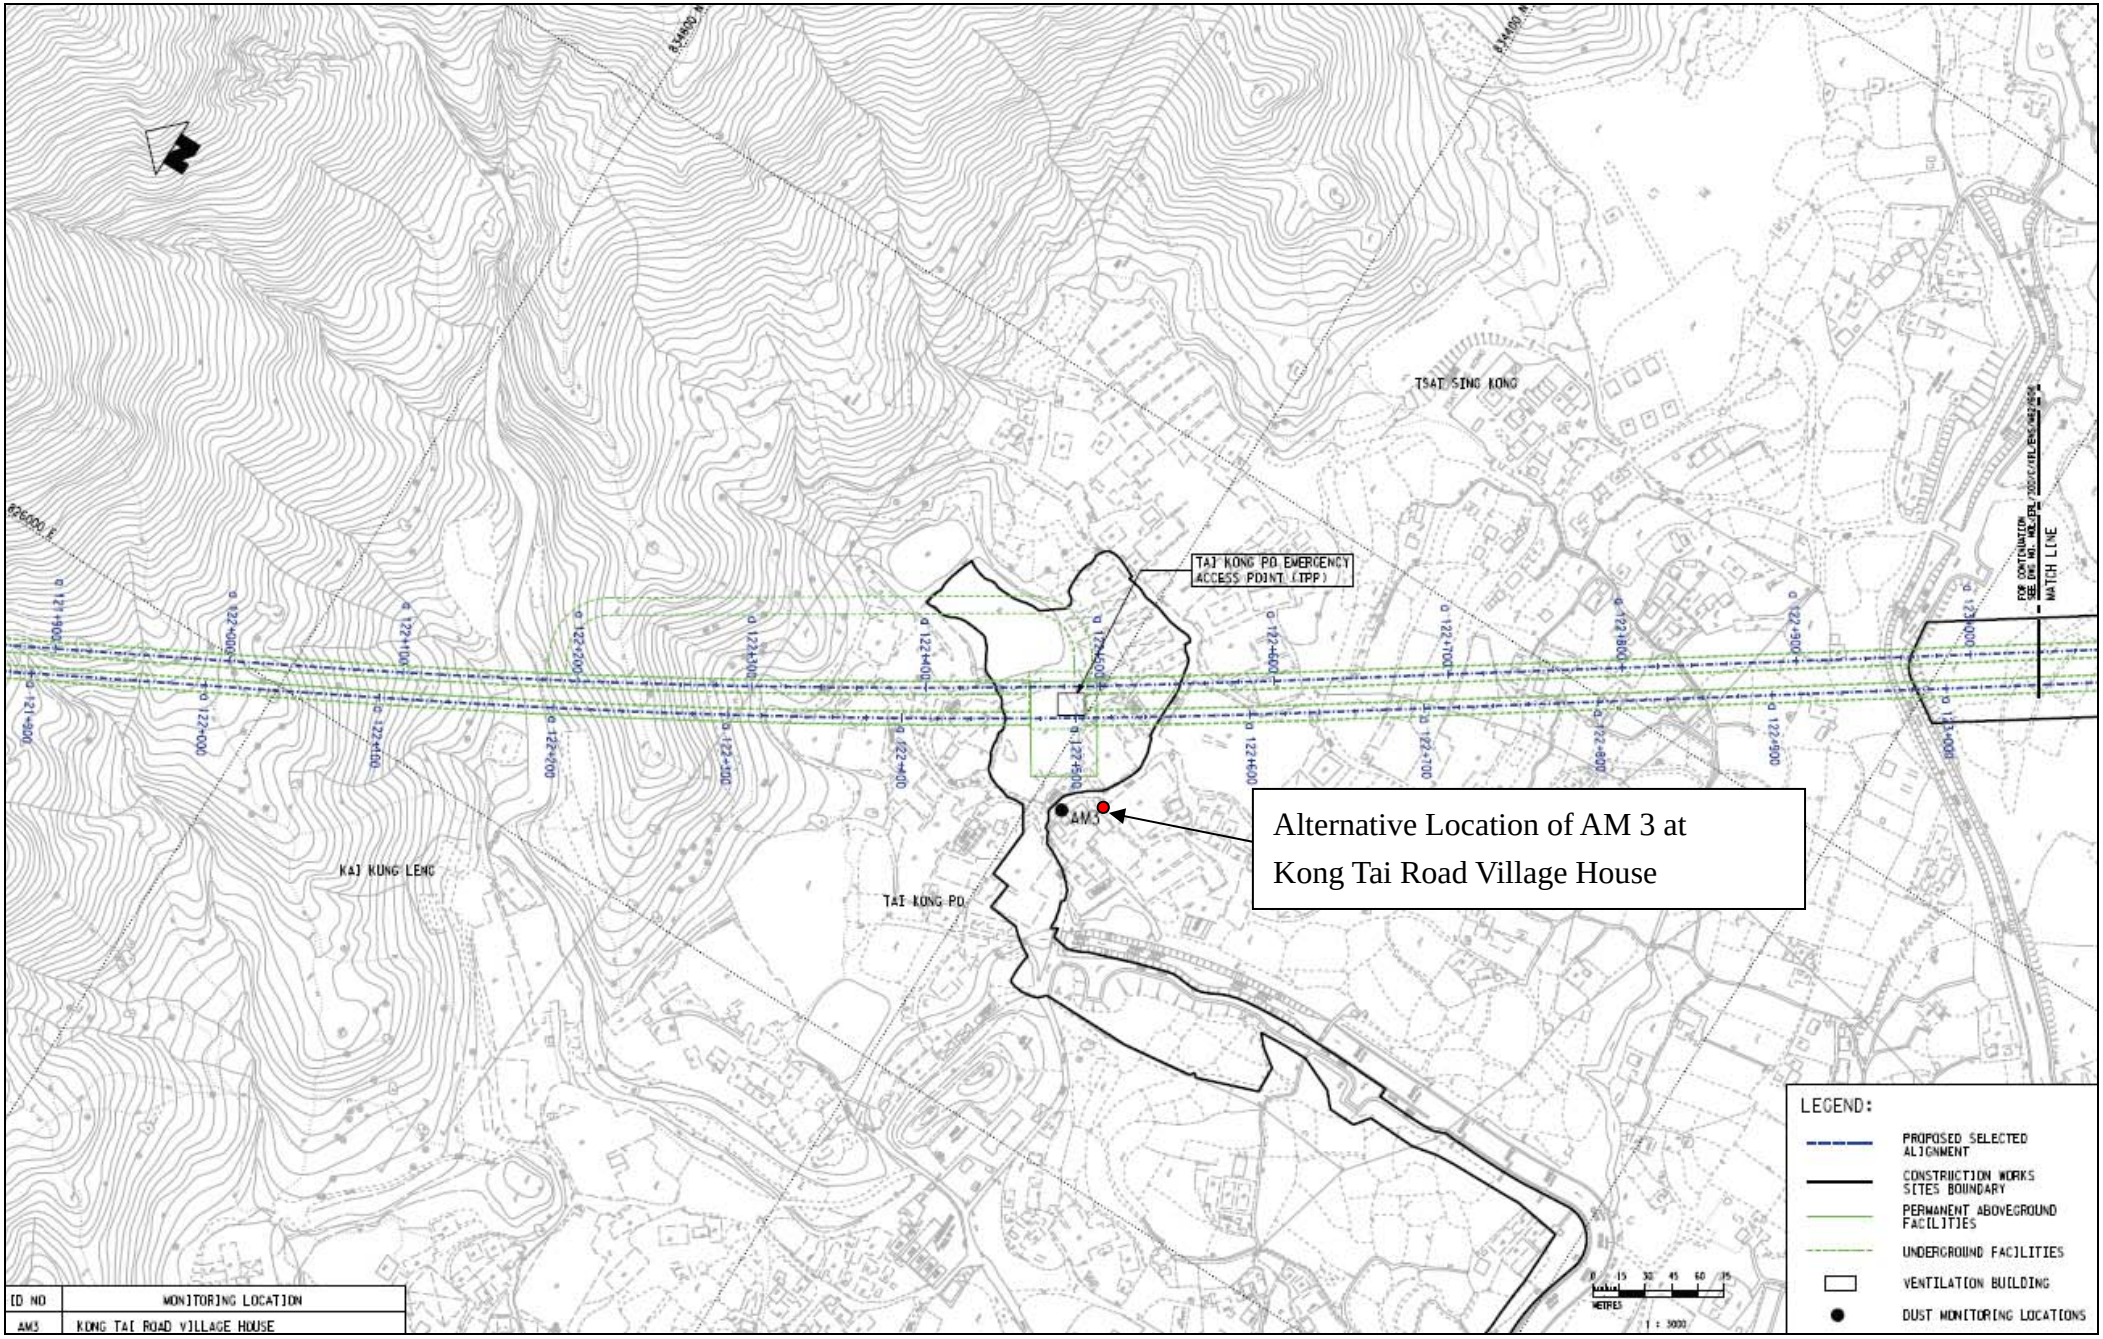

TSAT SING KONG
TAI KONG PO EMERGENCY ACCESS POINT (TPP)
AM3
Alternative Location of AM 3 at Kong Tai Road Village House
KAI KONG LENG
TAI KONG PO
MATCH LINE
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
DUST MONITORING LOCATIONS
ID NO
MONITORING LOCATION
AM3
KONG TAI ROAD VILLAGE HOUSE

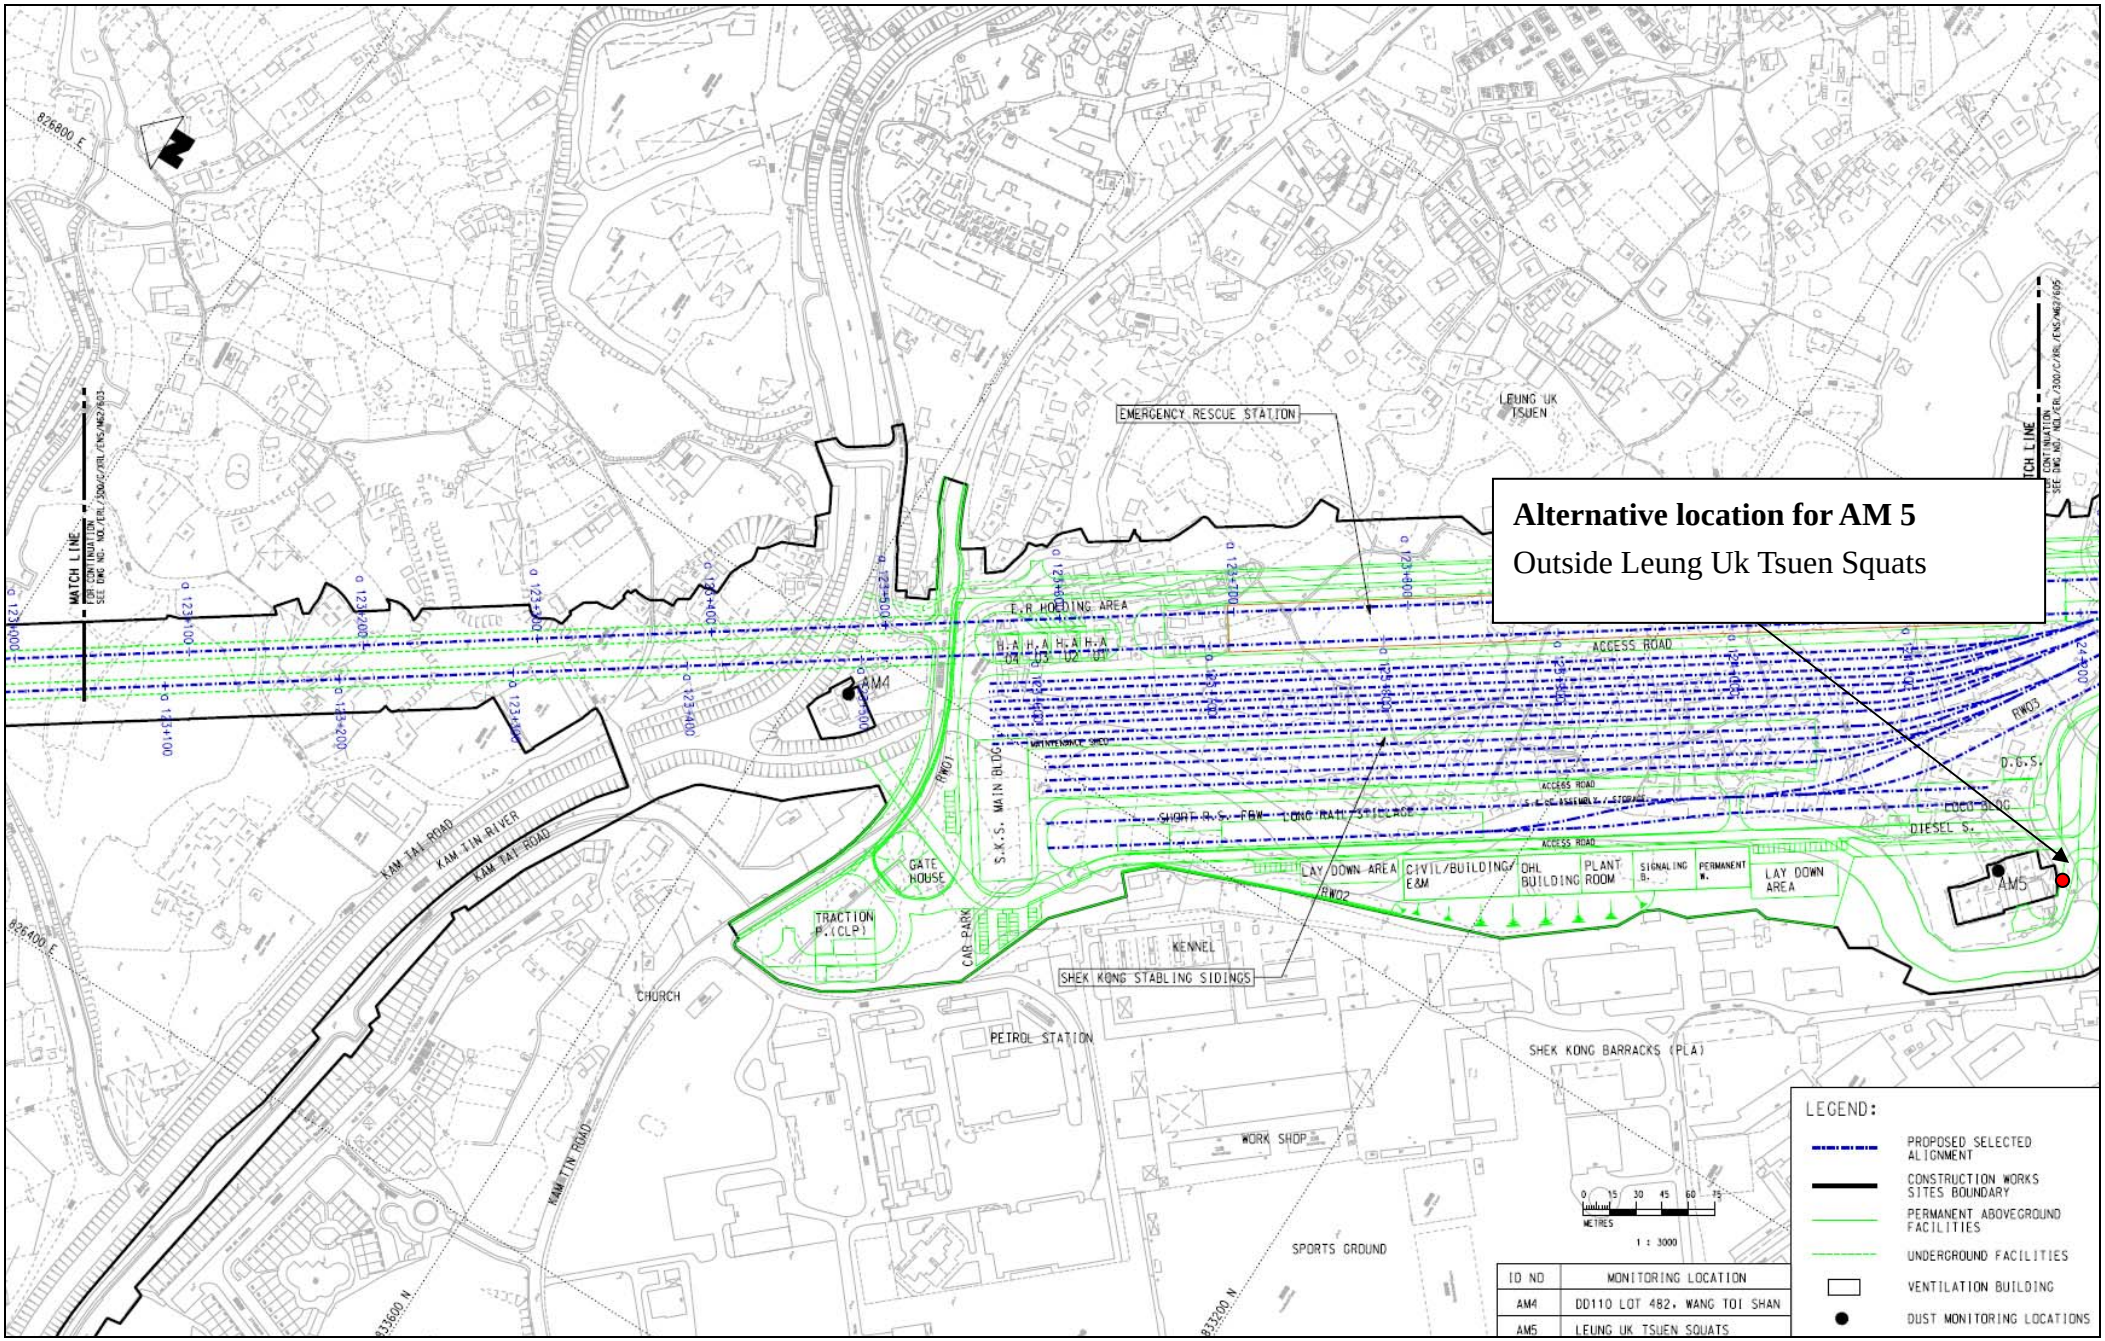
Alternative location for AM 5
Outside Leung Uk Tsuen Squats
EMERGENCY RESCUE STATION
LEUNG UK TSUEN
MATCH LINE
ACCESS ROAD
T.R HOEDING AREA
AM4
AM5
S.K.S. MAIN BLDG.
GATE HOUSE
TRACTION P.(CLP)
CAR PARK
KENNEL
SHEK KONG STABLING SIDINGS
CHURCH
PETROL STATION
WORK SHOP
SHEK KONG BARRACKS (PLA)
SPORTS GROUND
KAM TAI ROAD
KAM TIN RIVER
KAM TIN ROAD
LAY DOWN AREA
CIVIL/BUILDING E&M
OHL BUILDING
PLANT ROOM
SIGNALING B.
PERMANENT W.
LAY DOWN AREA
D.G.S.
DIESEL S.
826800 E
826400 E
833600 N
833200 N
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
DUST MONITORING LOCATIONS
METRES
1 : 3000
ID NO
MONITORING LOCATION
AM4
DD110 LOT 482, WANG TOI SHAN
AM5
LEUNG UK TSUEN SQUATS

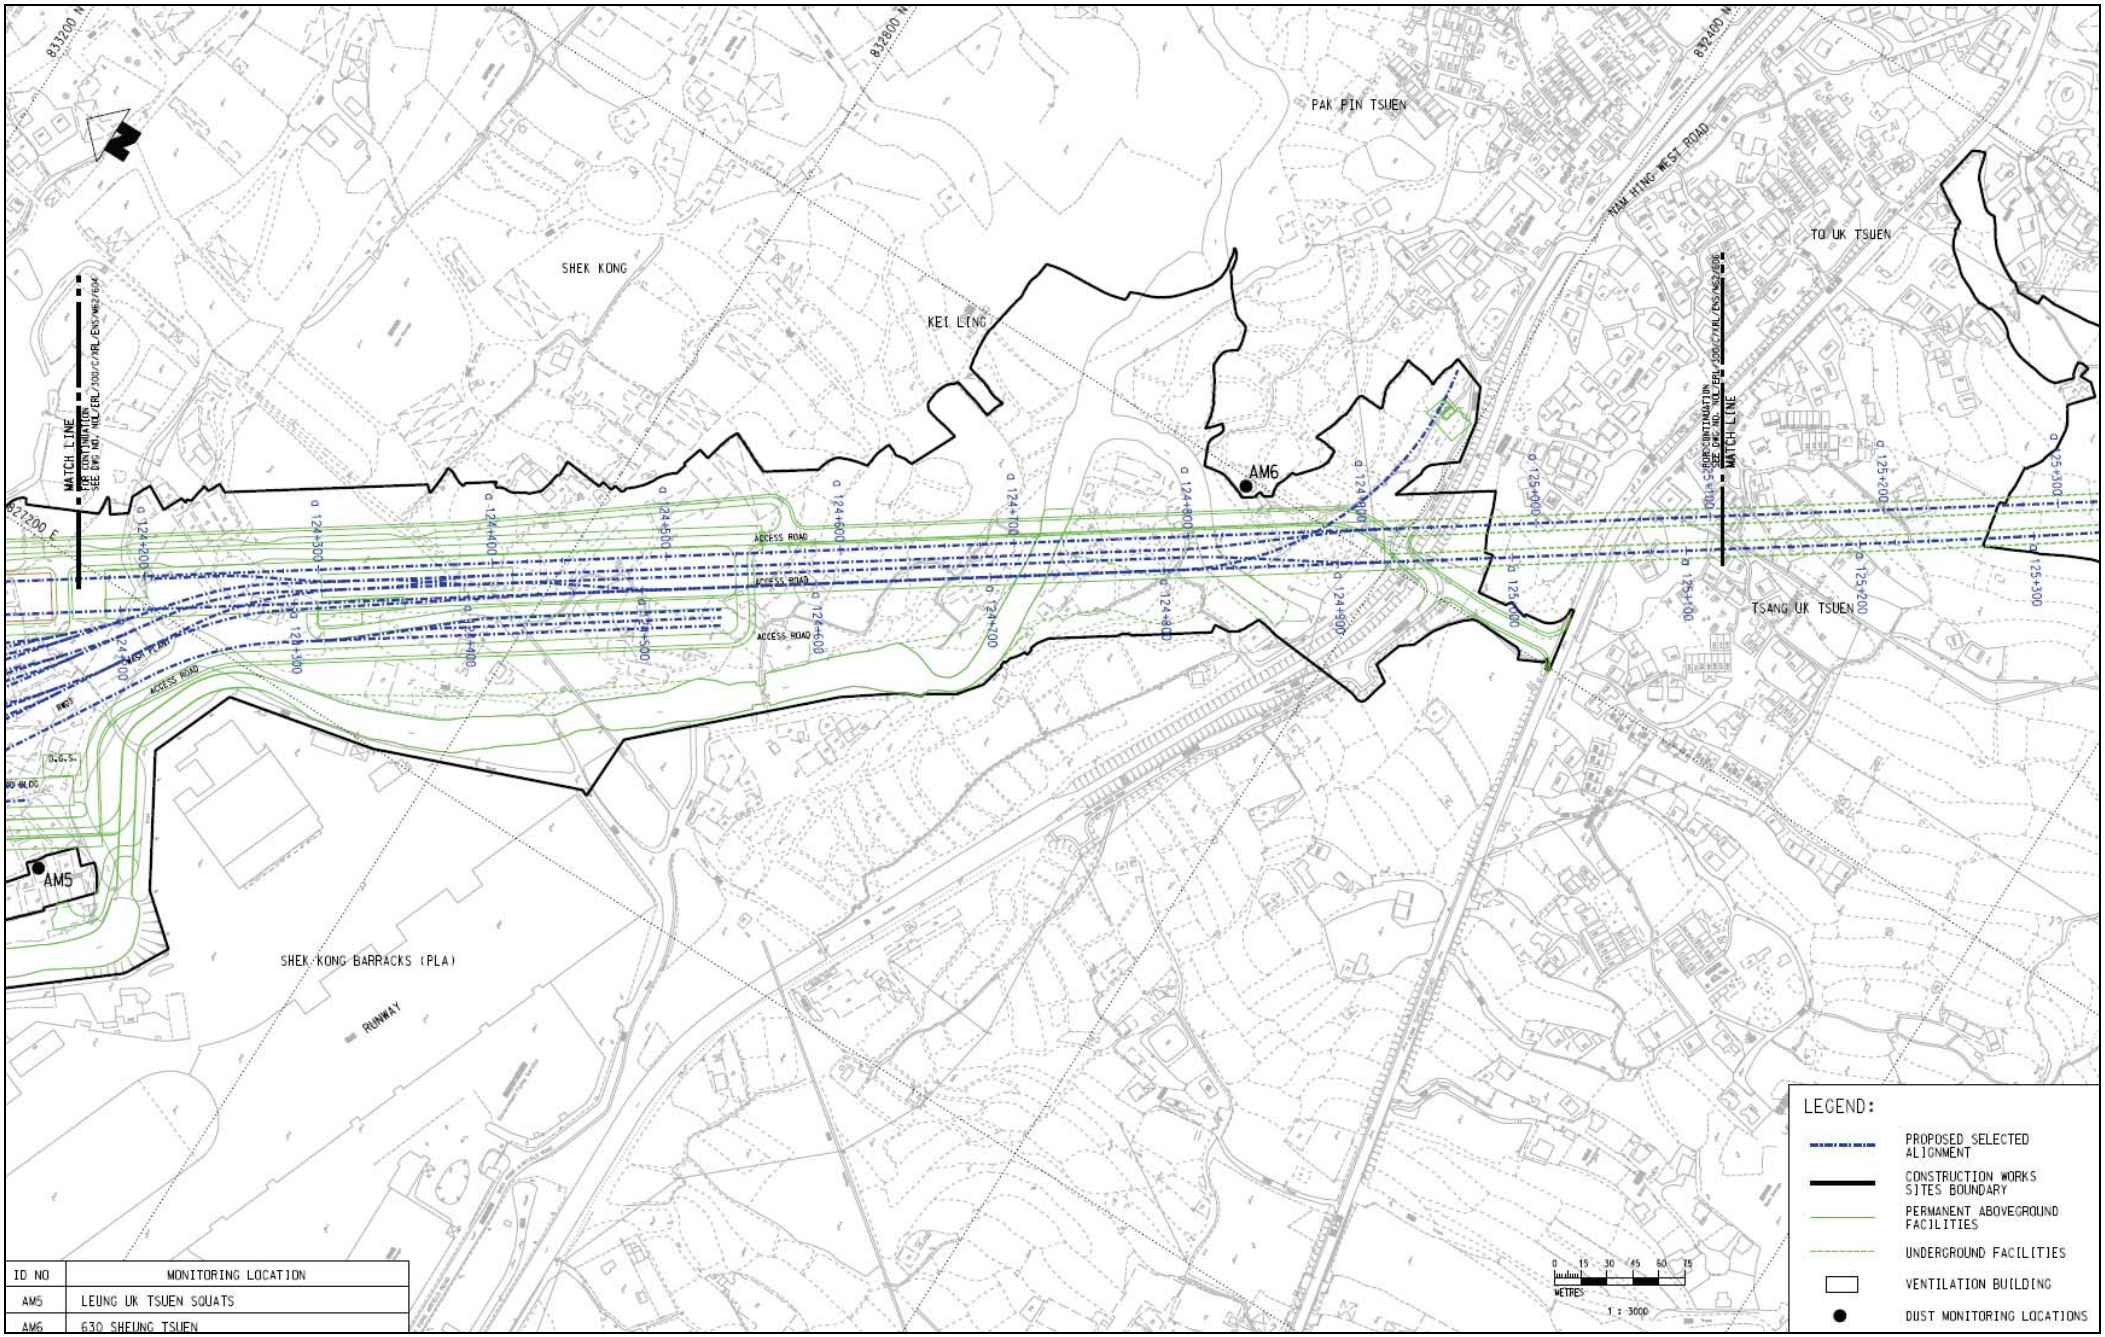



ID NO	MONITORING LOCATION
AM5	LEUNG UK TSUEN SQUATS
AM6	630 SHEUNG TSUEN

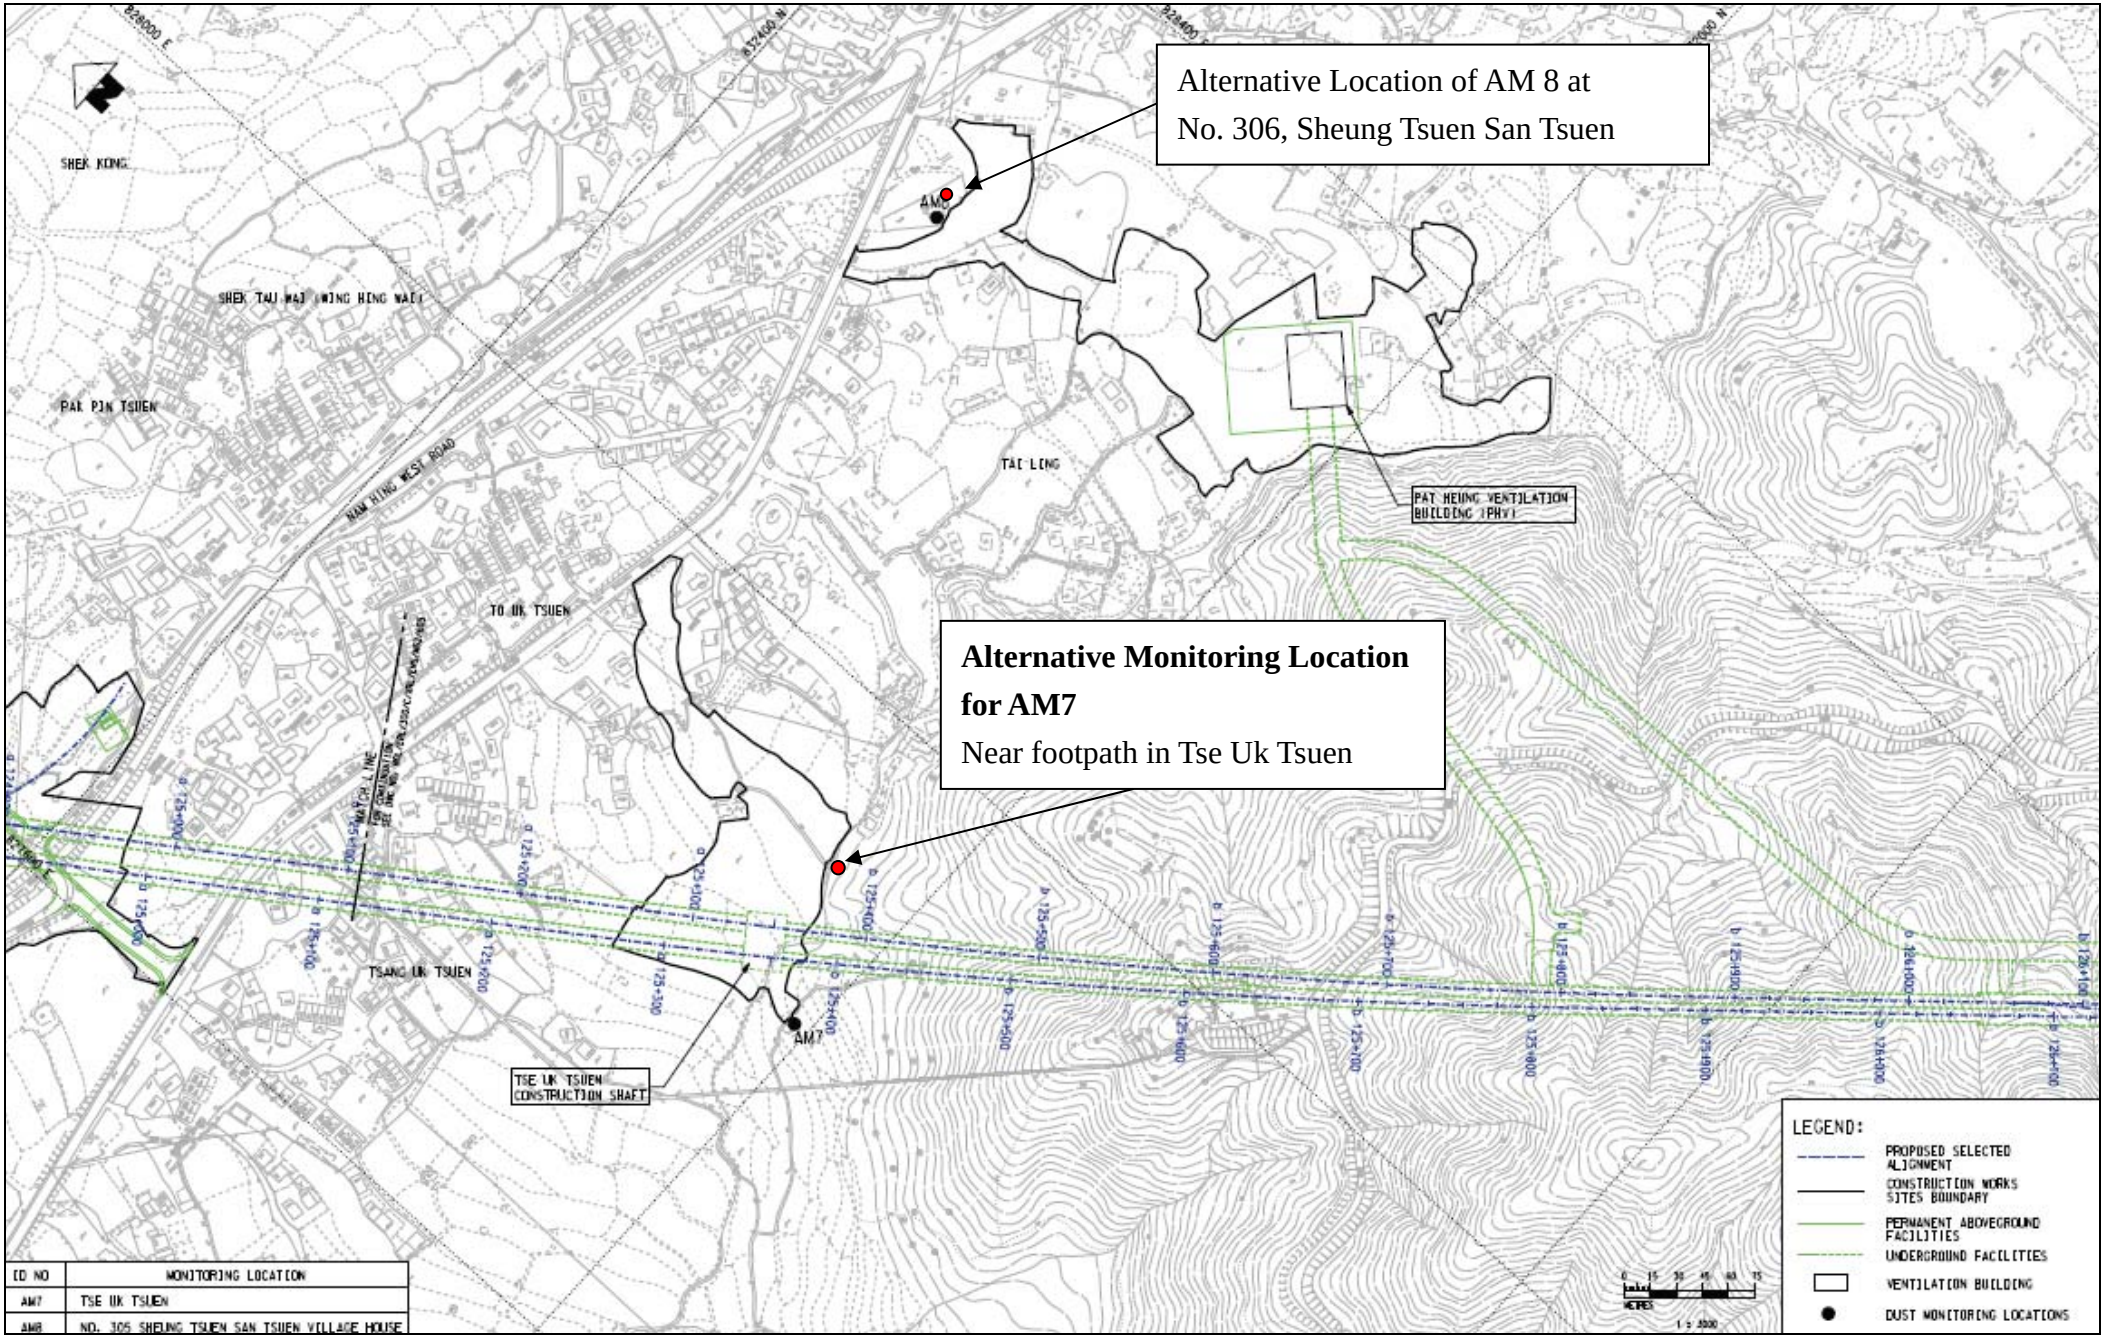
Alternative Location of AM 8 at
No. 306, Sheung Tsuen San Tsuen
Alternative Monitoring Location for AM7
Near footpath in Tse Uk Tsuen
AM8
AM7
SHEK KONG
SHEK TAU WAI (WING HING WAI)
PAK PIN TSUEN
WANG HING WEST ROAD
TAI LONG
PAT HEUNG VENTILATION BUILDING (PHV)
TO UK TSUEN
TSANG UK TSUEN
TSE UK TSUEN CONSTRUCTION SHAFT
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
DUST MONITORING LOCATIONS
ID NO
MONITORING LOCATION
AM7
TSE UK TSUEN
AM8
NO. 305 SHEUNG TSUEN SAN TSUEN VILLAGE HOUSE

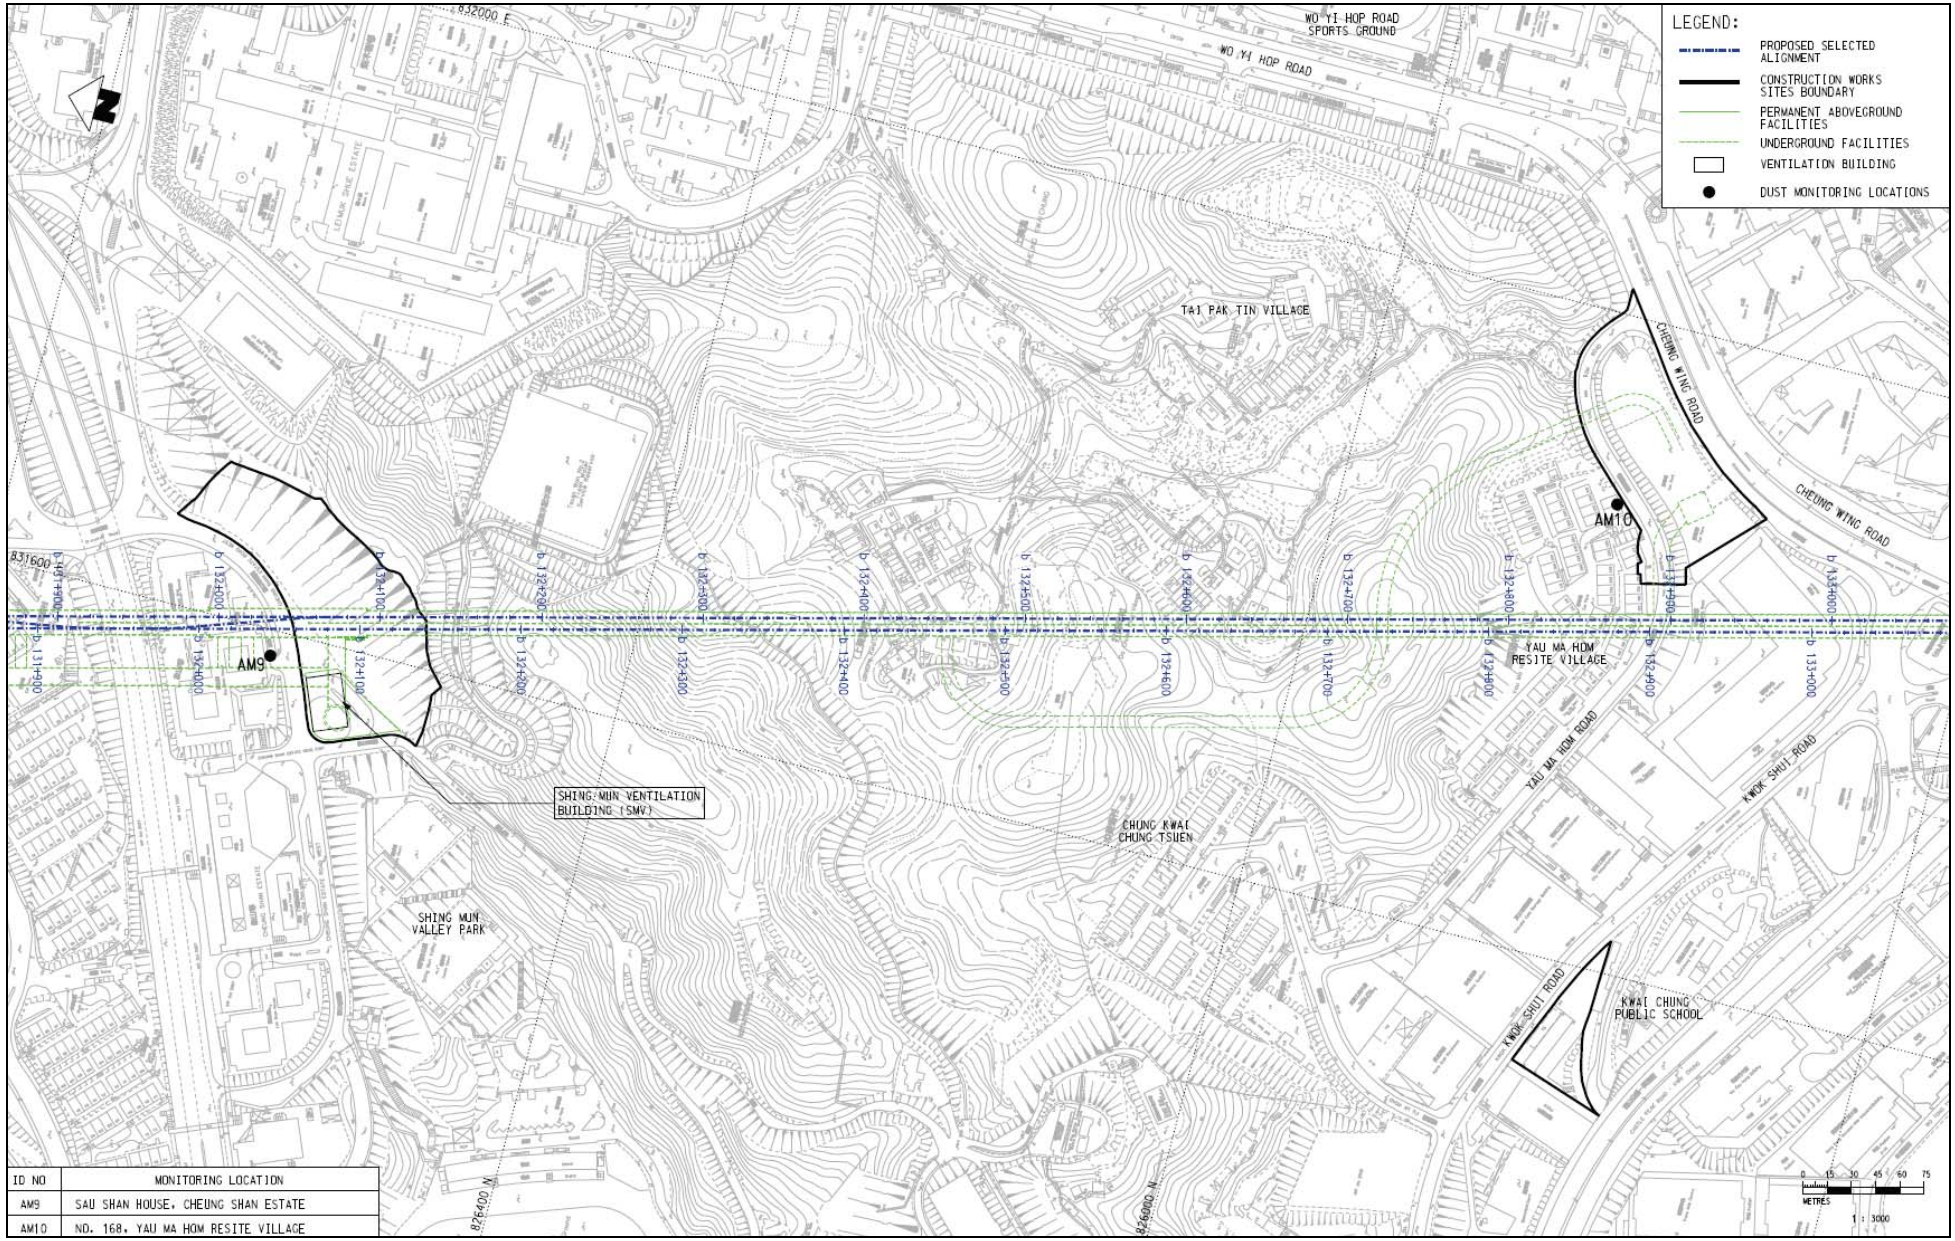


ID NO	MONITORING LOCATION
AM9	SAU SHAN HOUSE, CHEUNG SHAN ESTATE
AM10	NO. 168, YAU MA HOM RESITE VILLAGE

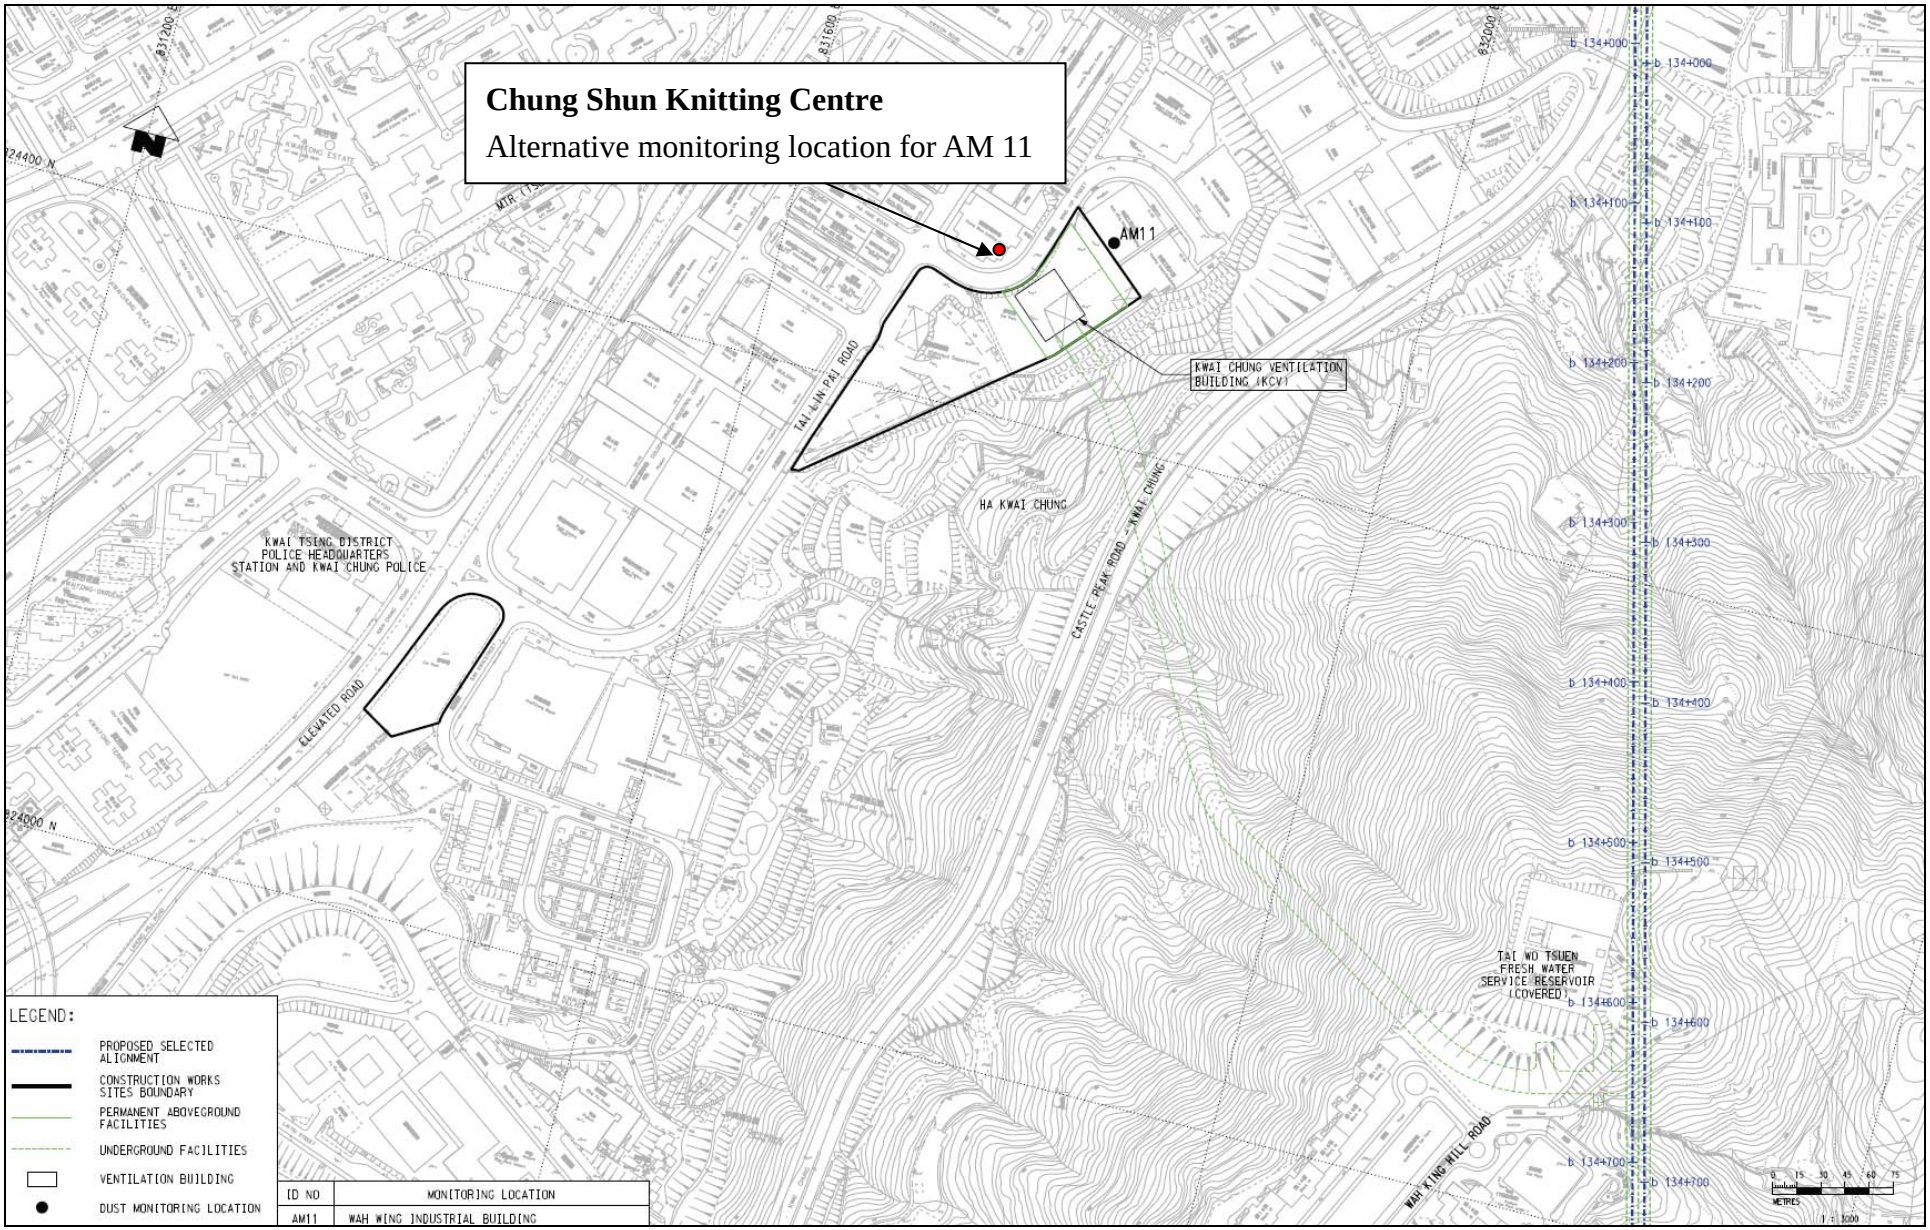

Chung Shun Knitting Centre
Alternative monitoring location for AM 11
AM11
KWAI CHUNG VENTILATION BUILDING (KCV)
TAI KLIN PAI ROAD
HA KWAI CHUNG
CASTLE PEAK ROAD - KWAI CHUNG
KWAI TSING DISTRICT POLICE HEADQUARTERS STATION AND KWAI CHUNG POLICE
ELEVATED ROAD
TAI WO TSUEN FRESH WATER SERVICE RESERVOIR (COVERED)
WAH KING HILL ROAD
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
DUST MONITORING LOCATION
ID NO
MONITORING LOCATION
AM11
WAH WING INDUSTRIAL BUILDING

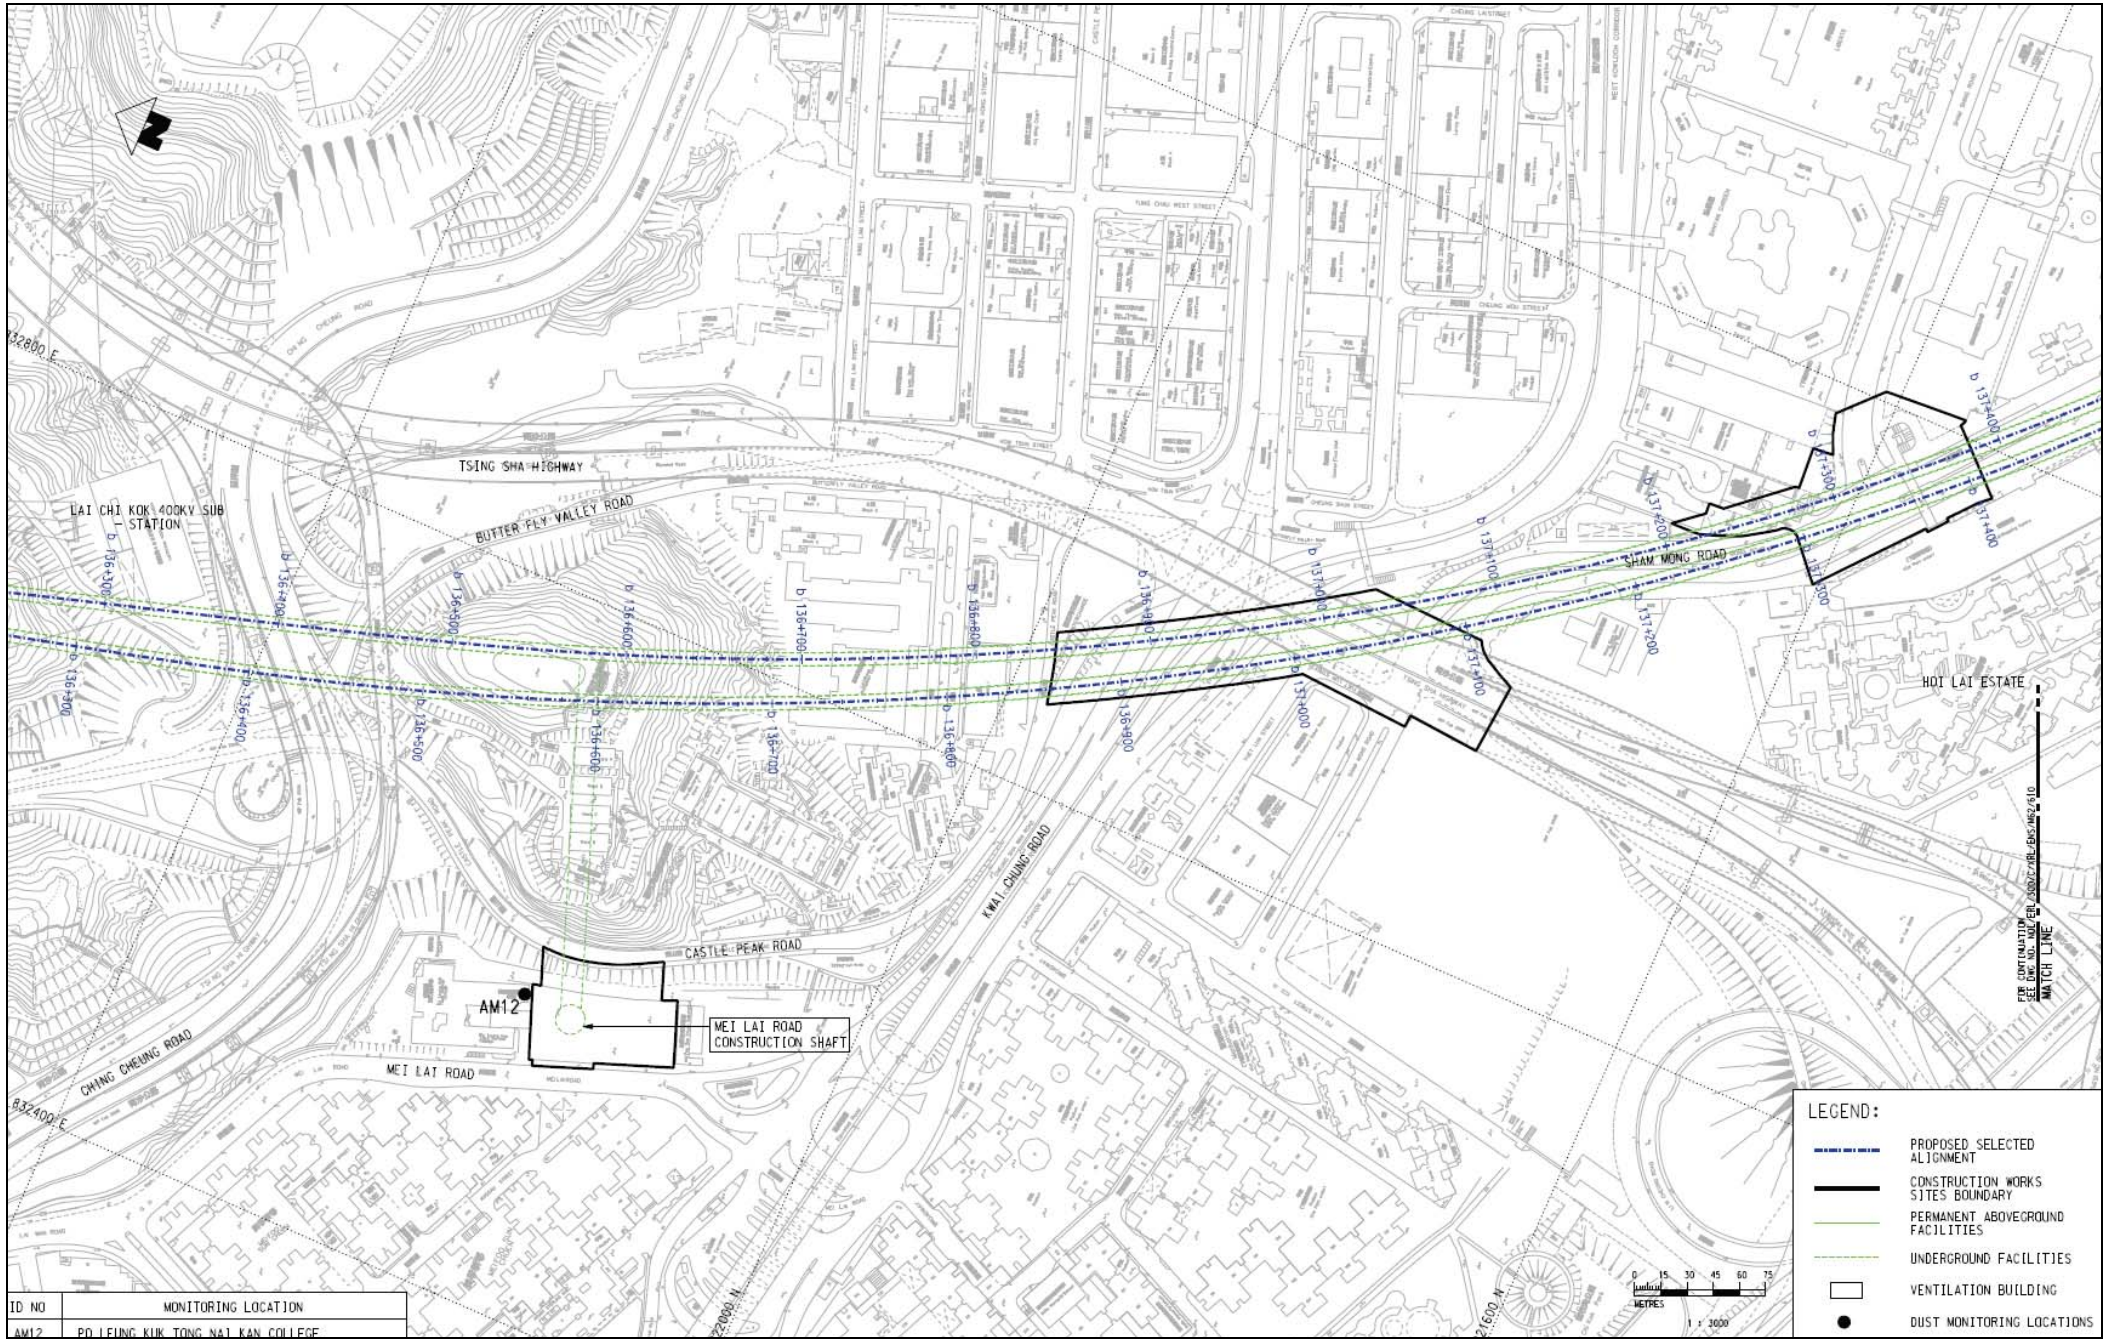


ID NO	MONITORING LOCATION
AM12	PO LEUNG KUK TONG NAI KAN COLLEGE

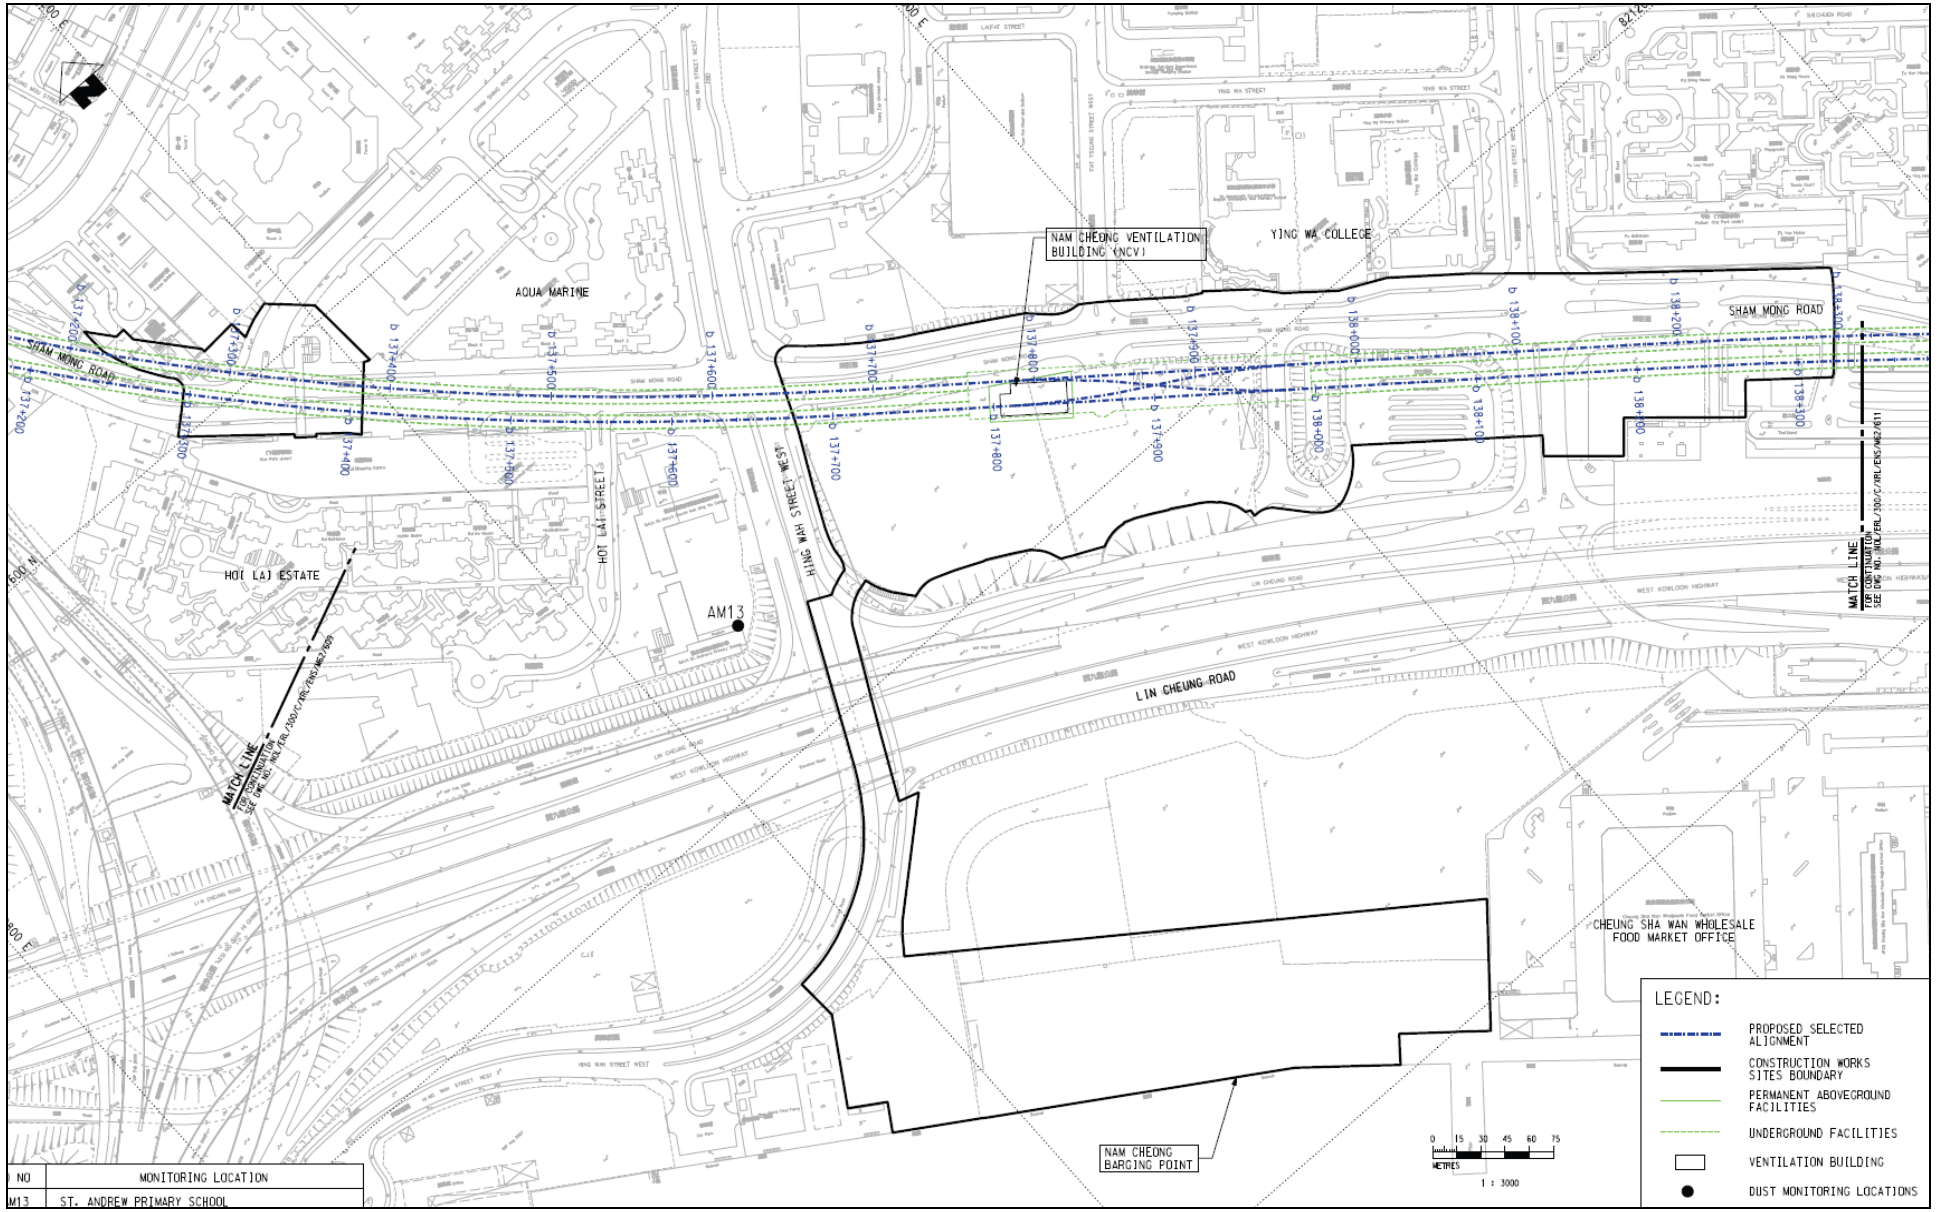


NO	MONITORING LOCATION
M13	ST. ANDREW PRIMARY SCHOOL

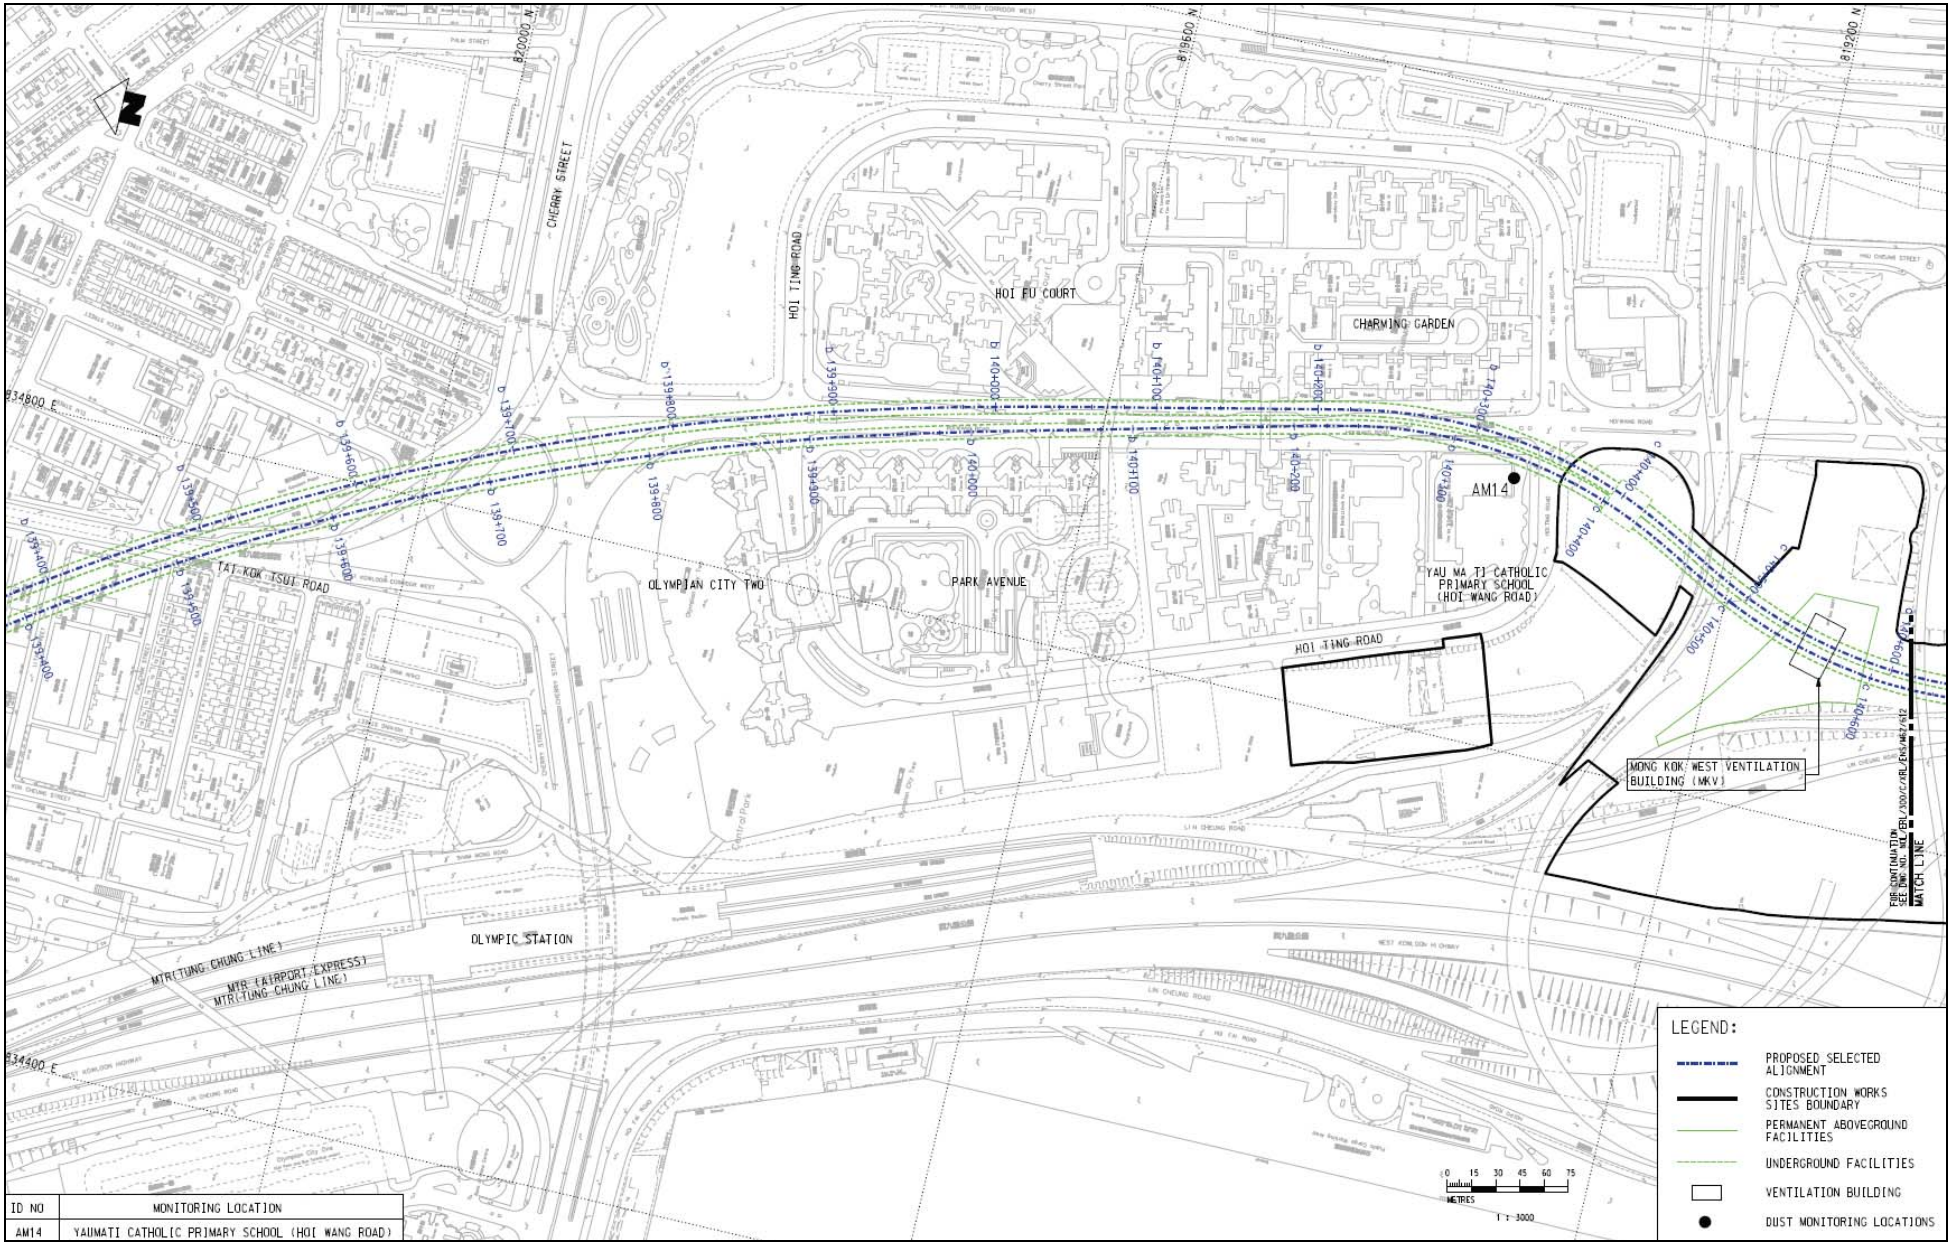


ID NO	MONITORING LOCATION
AM14	YAUMATI CATHOLIC PRIMARY SCHOOL (HOI WANG ROAD)

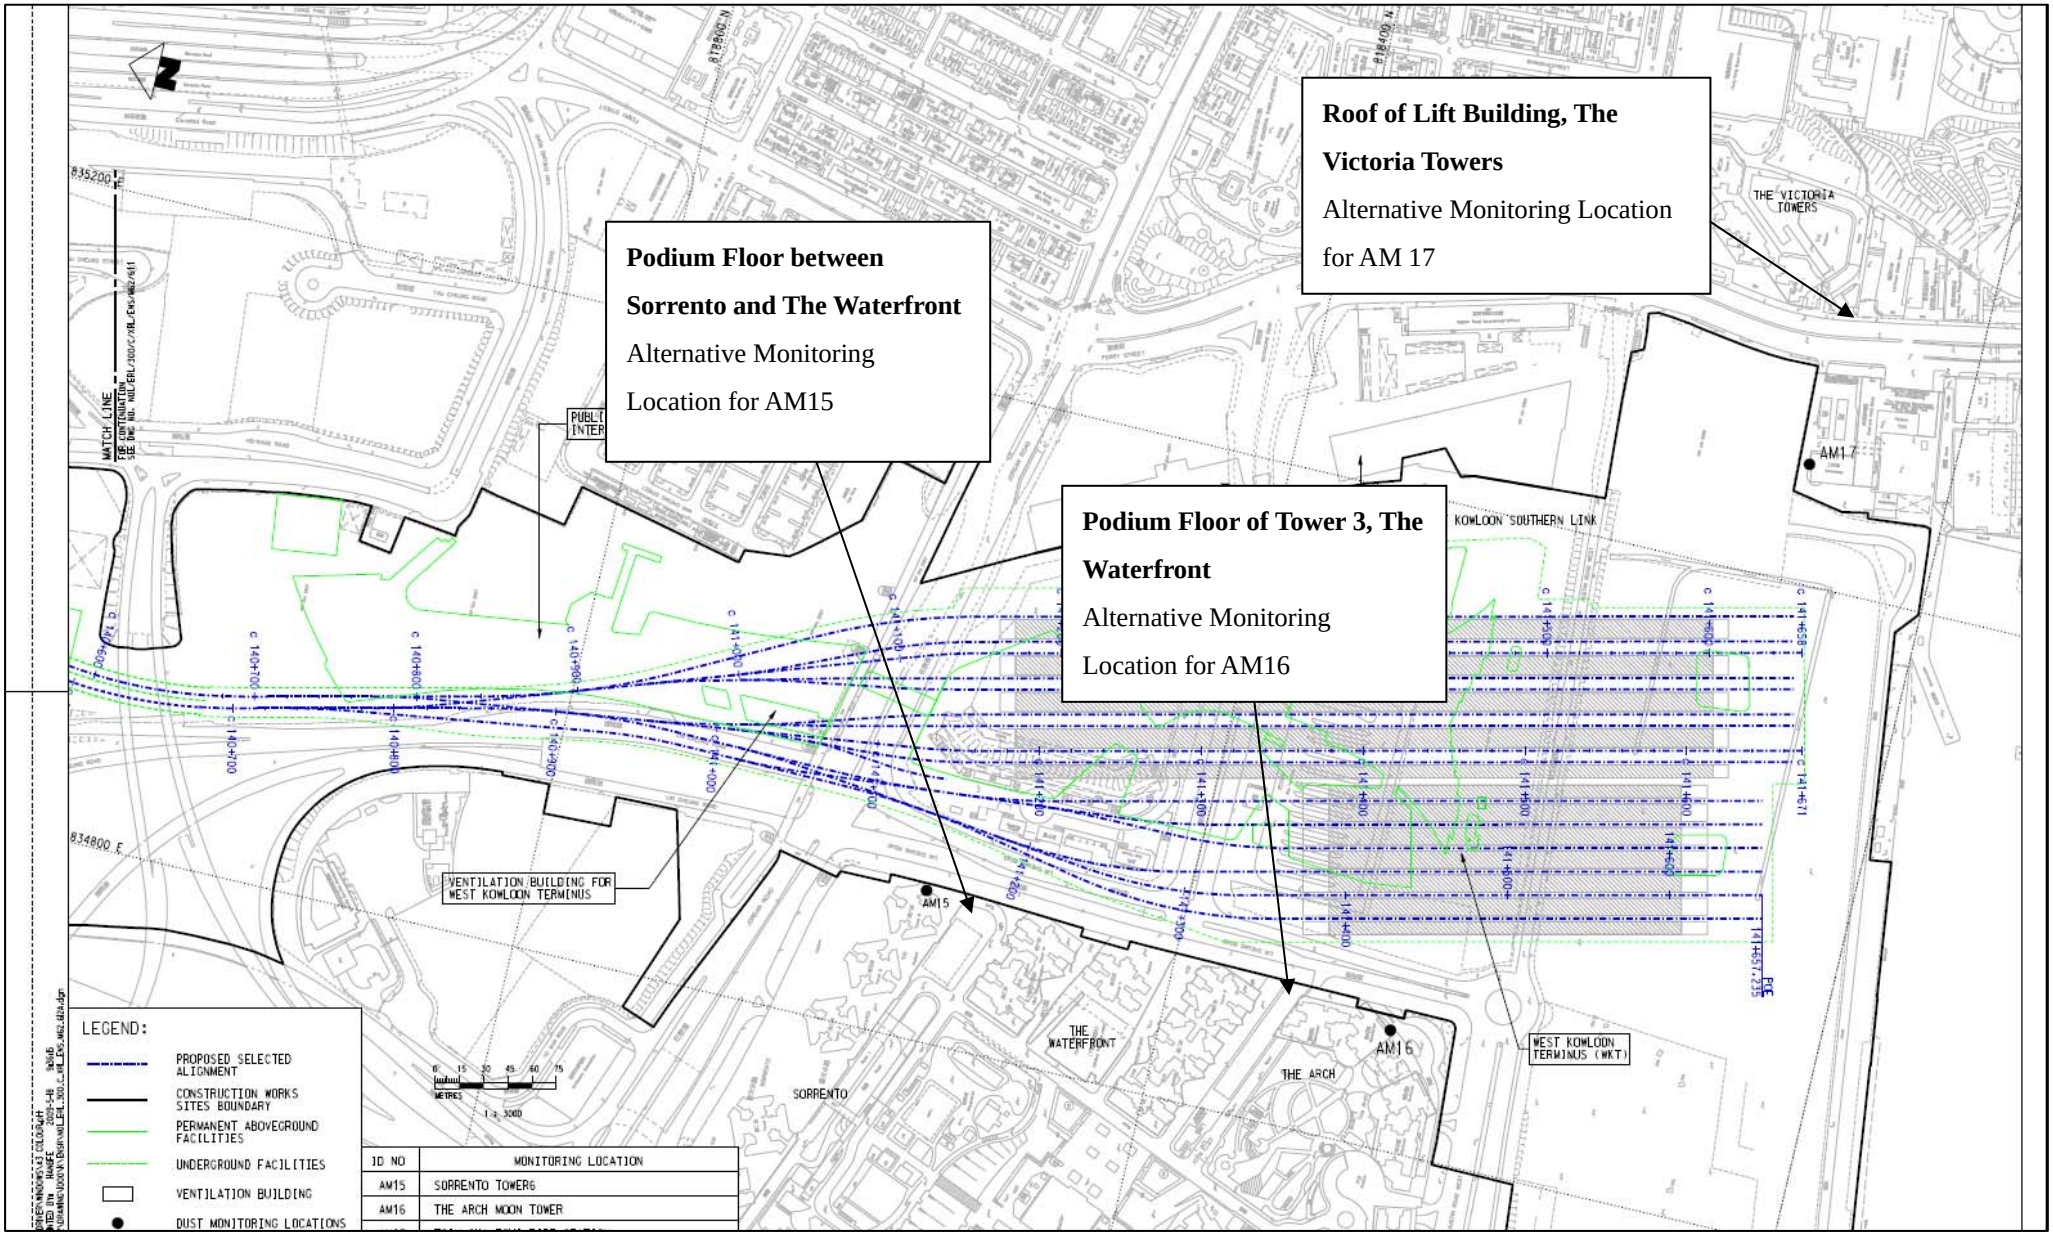


Dust monitoring locations

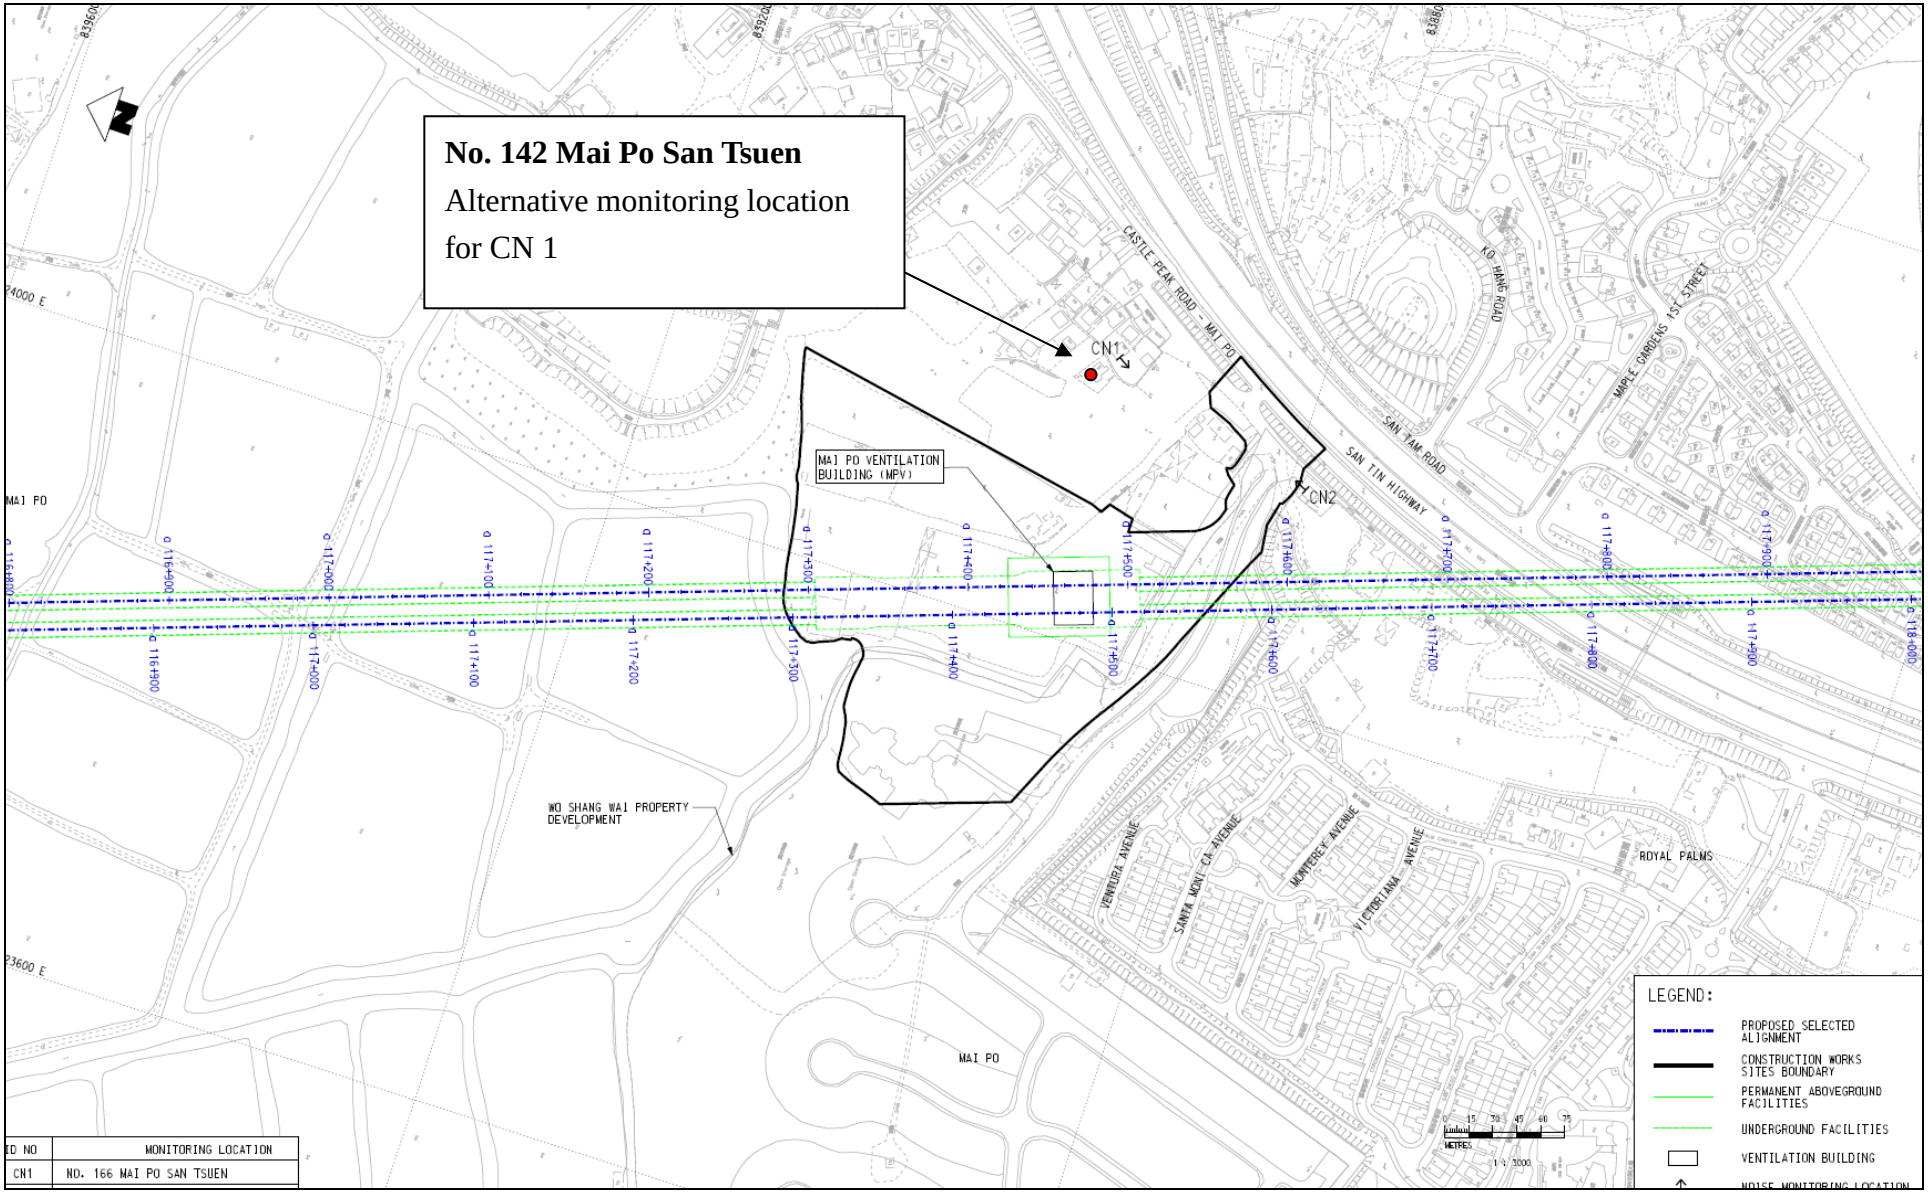
No. 142 Mai Po San Tsuen
Alternative monitoring location for CN 1
CN1
CN2
MAI PO VENTILATION BUILDING (MPV)
WO SHANG WAI PROPERTY DEVELOPMENT
MAI PO
CASTLE PEAK ROAD - MAI PO
KO HANG ROAD
MAPLE GARDENS
1ST STREET
SAN TAM ROAD
SAN TIN HIGHWAY
VENTURA AVENUE
SANTA MONICA AVENUE
MONTEREY AVENUE
VICTORIANA AVENUE
ROYAL PALMS
24000 E
23600 E
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
NOISE MONITORING LOCATION
METRES
1 : 3000
ID NO
MONITORING LOCATION
CN1
NO. 166 MAI PO SAN TSUEN

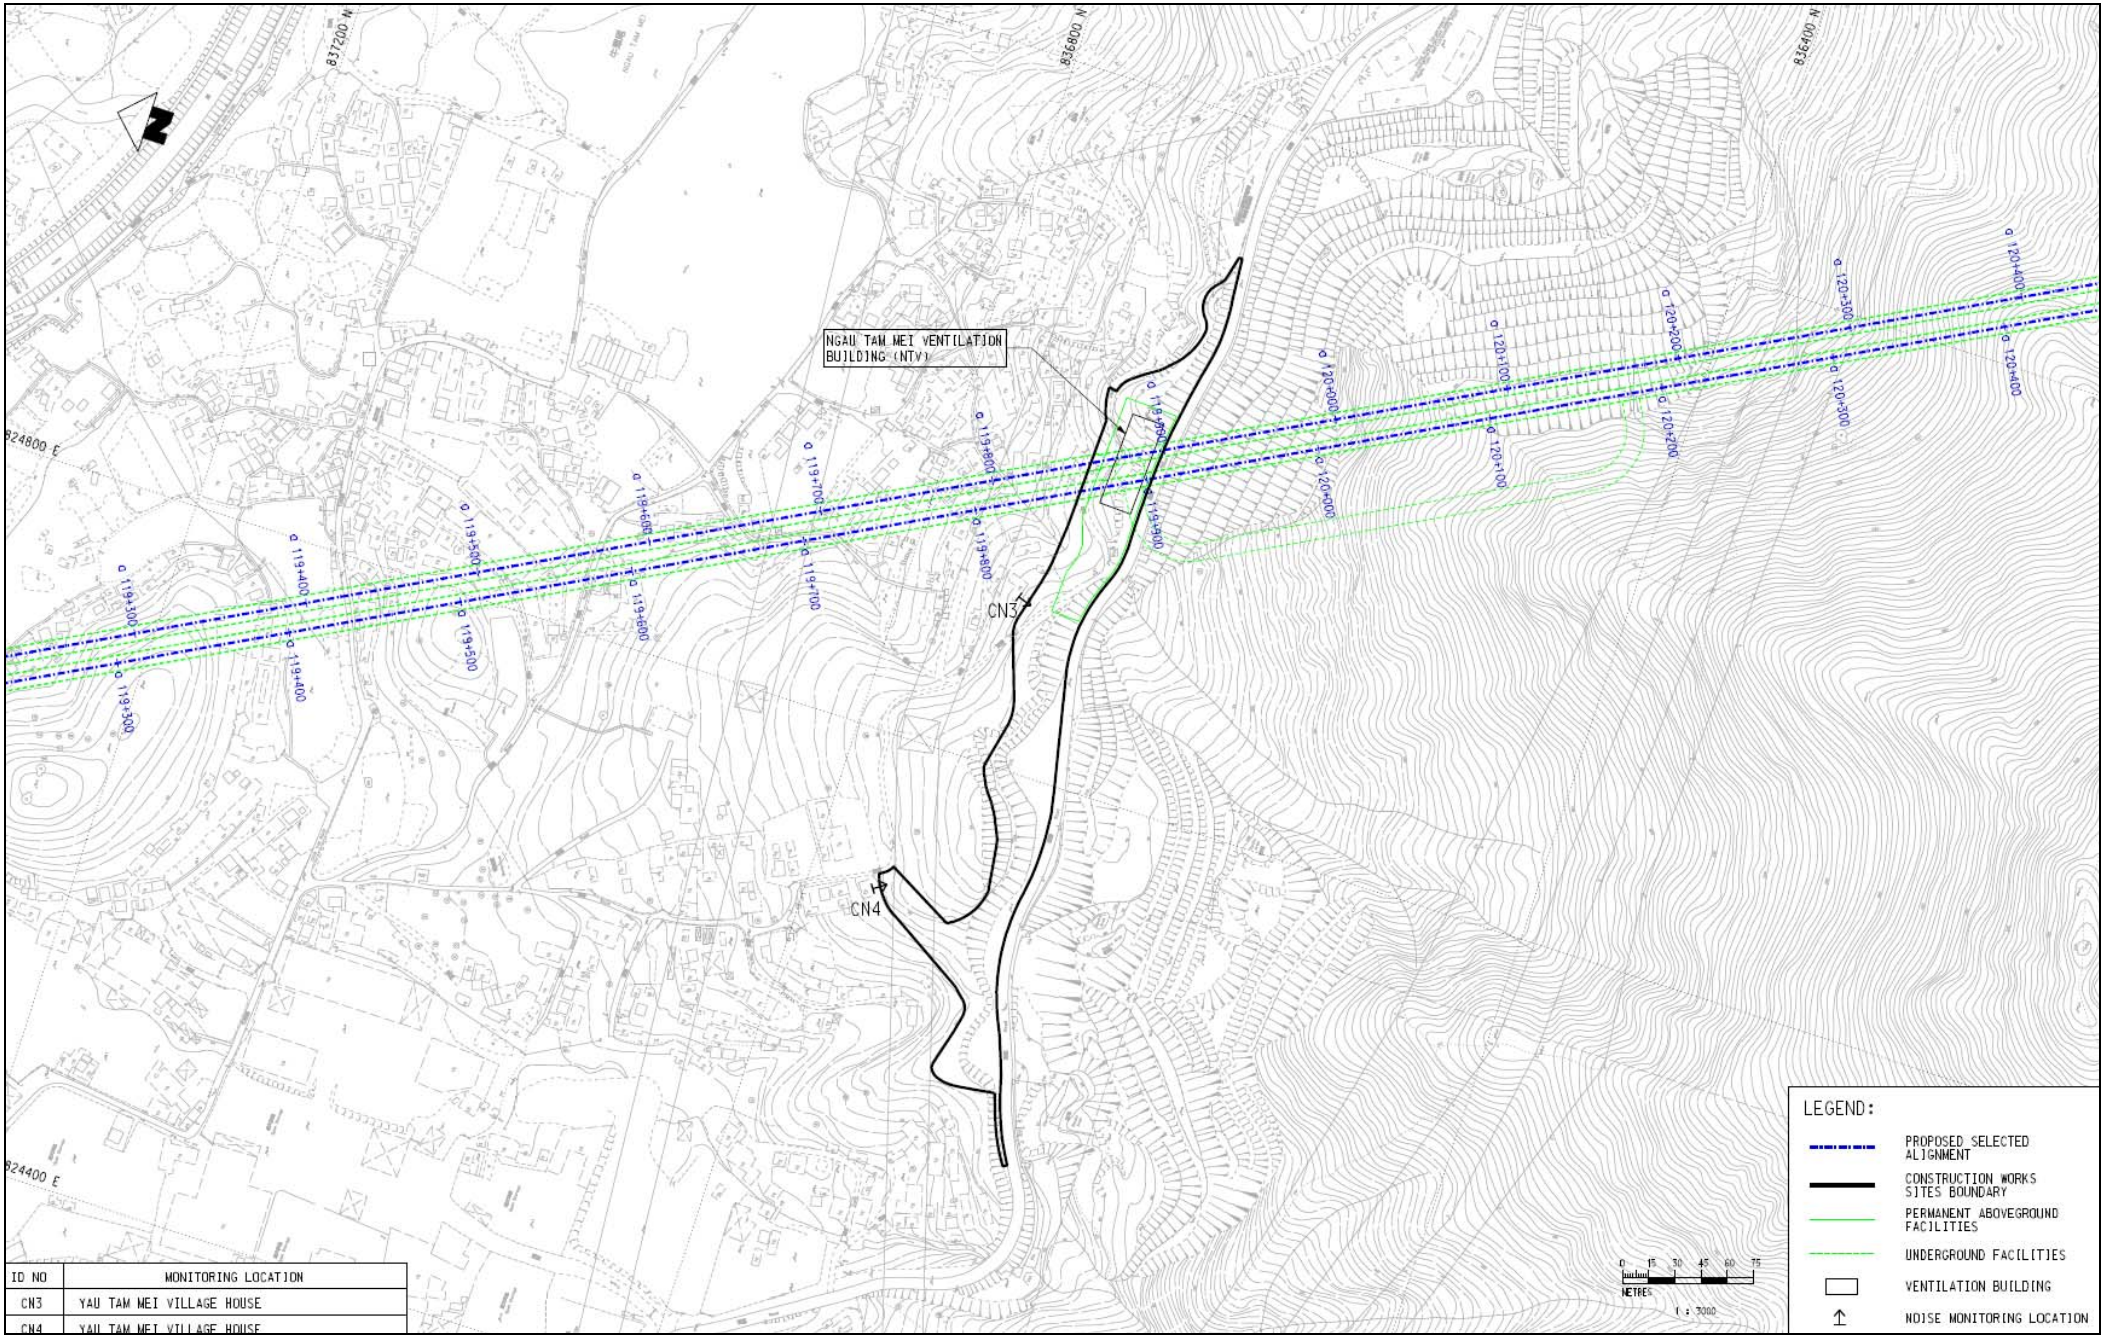

ID NO	MONITORING LOCATION
CN3	YAU TAM MEI VILLAGE HOUSE
CN4	YAU TAM MEI VILLAGE HOUSE

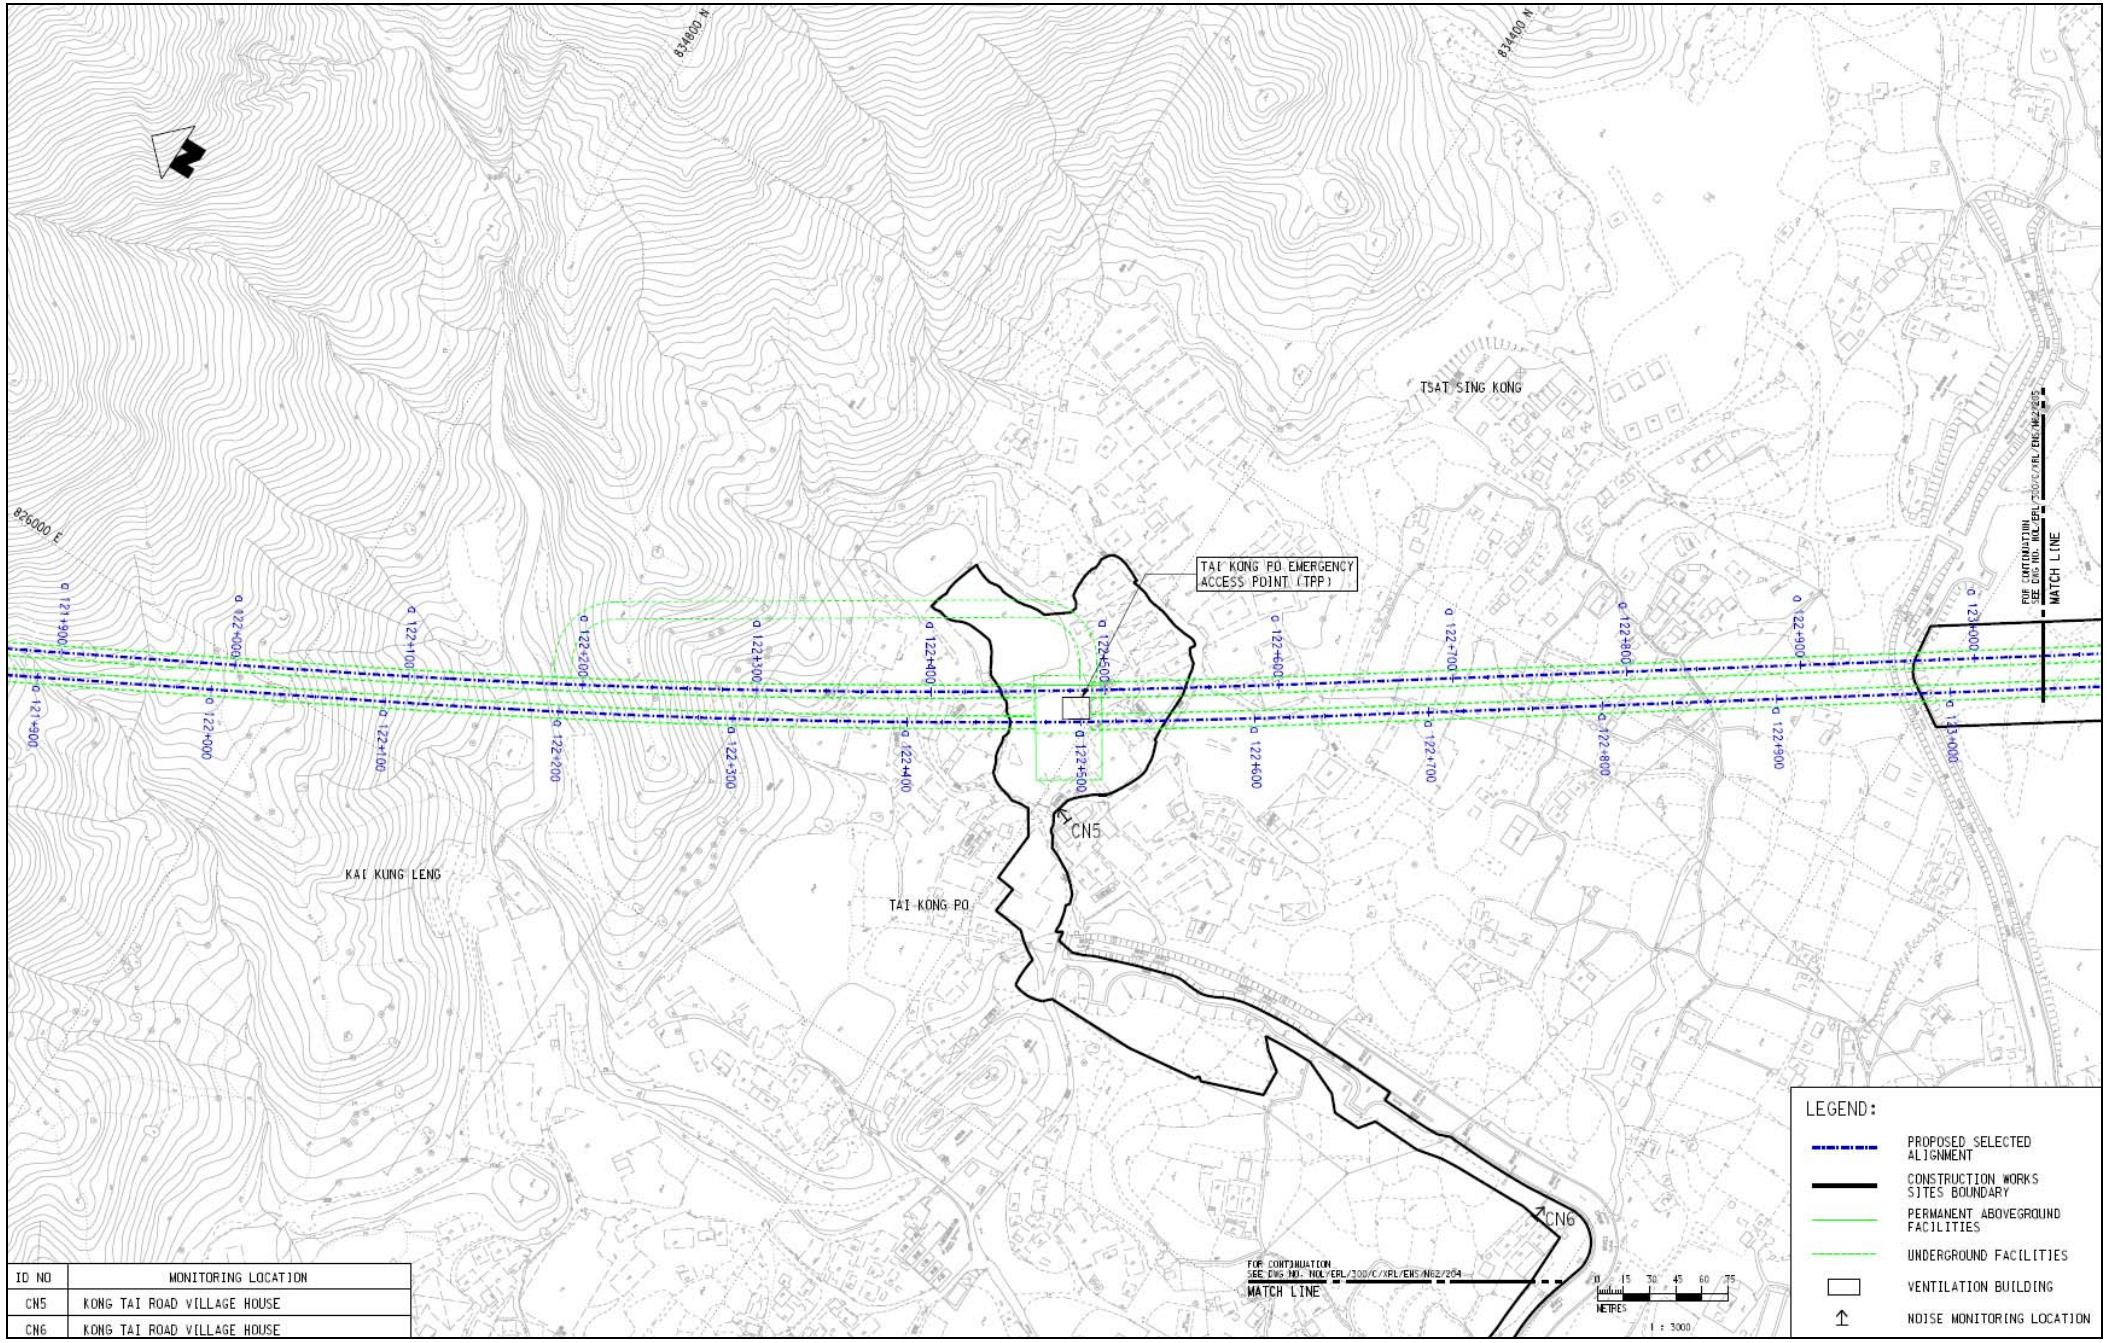

ID NO	MONITORING LOCATION
CN5	KONG TAI ROAD VILLAGE HOUSE
CN6	KONG TAI ROAD VILLAGE HOUSE




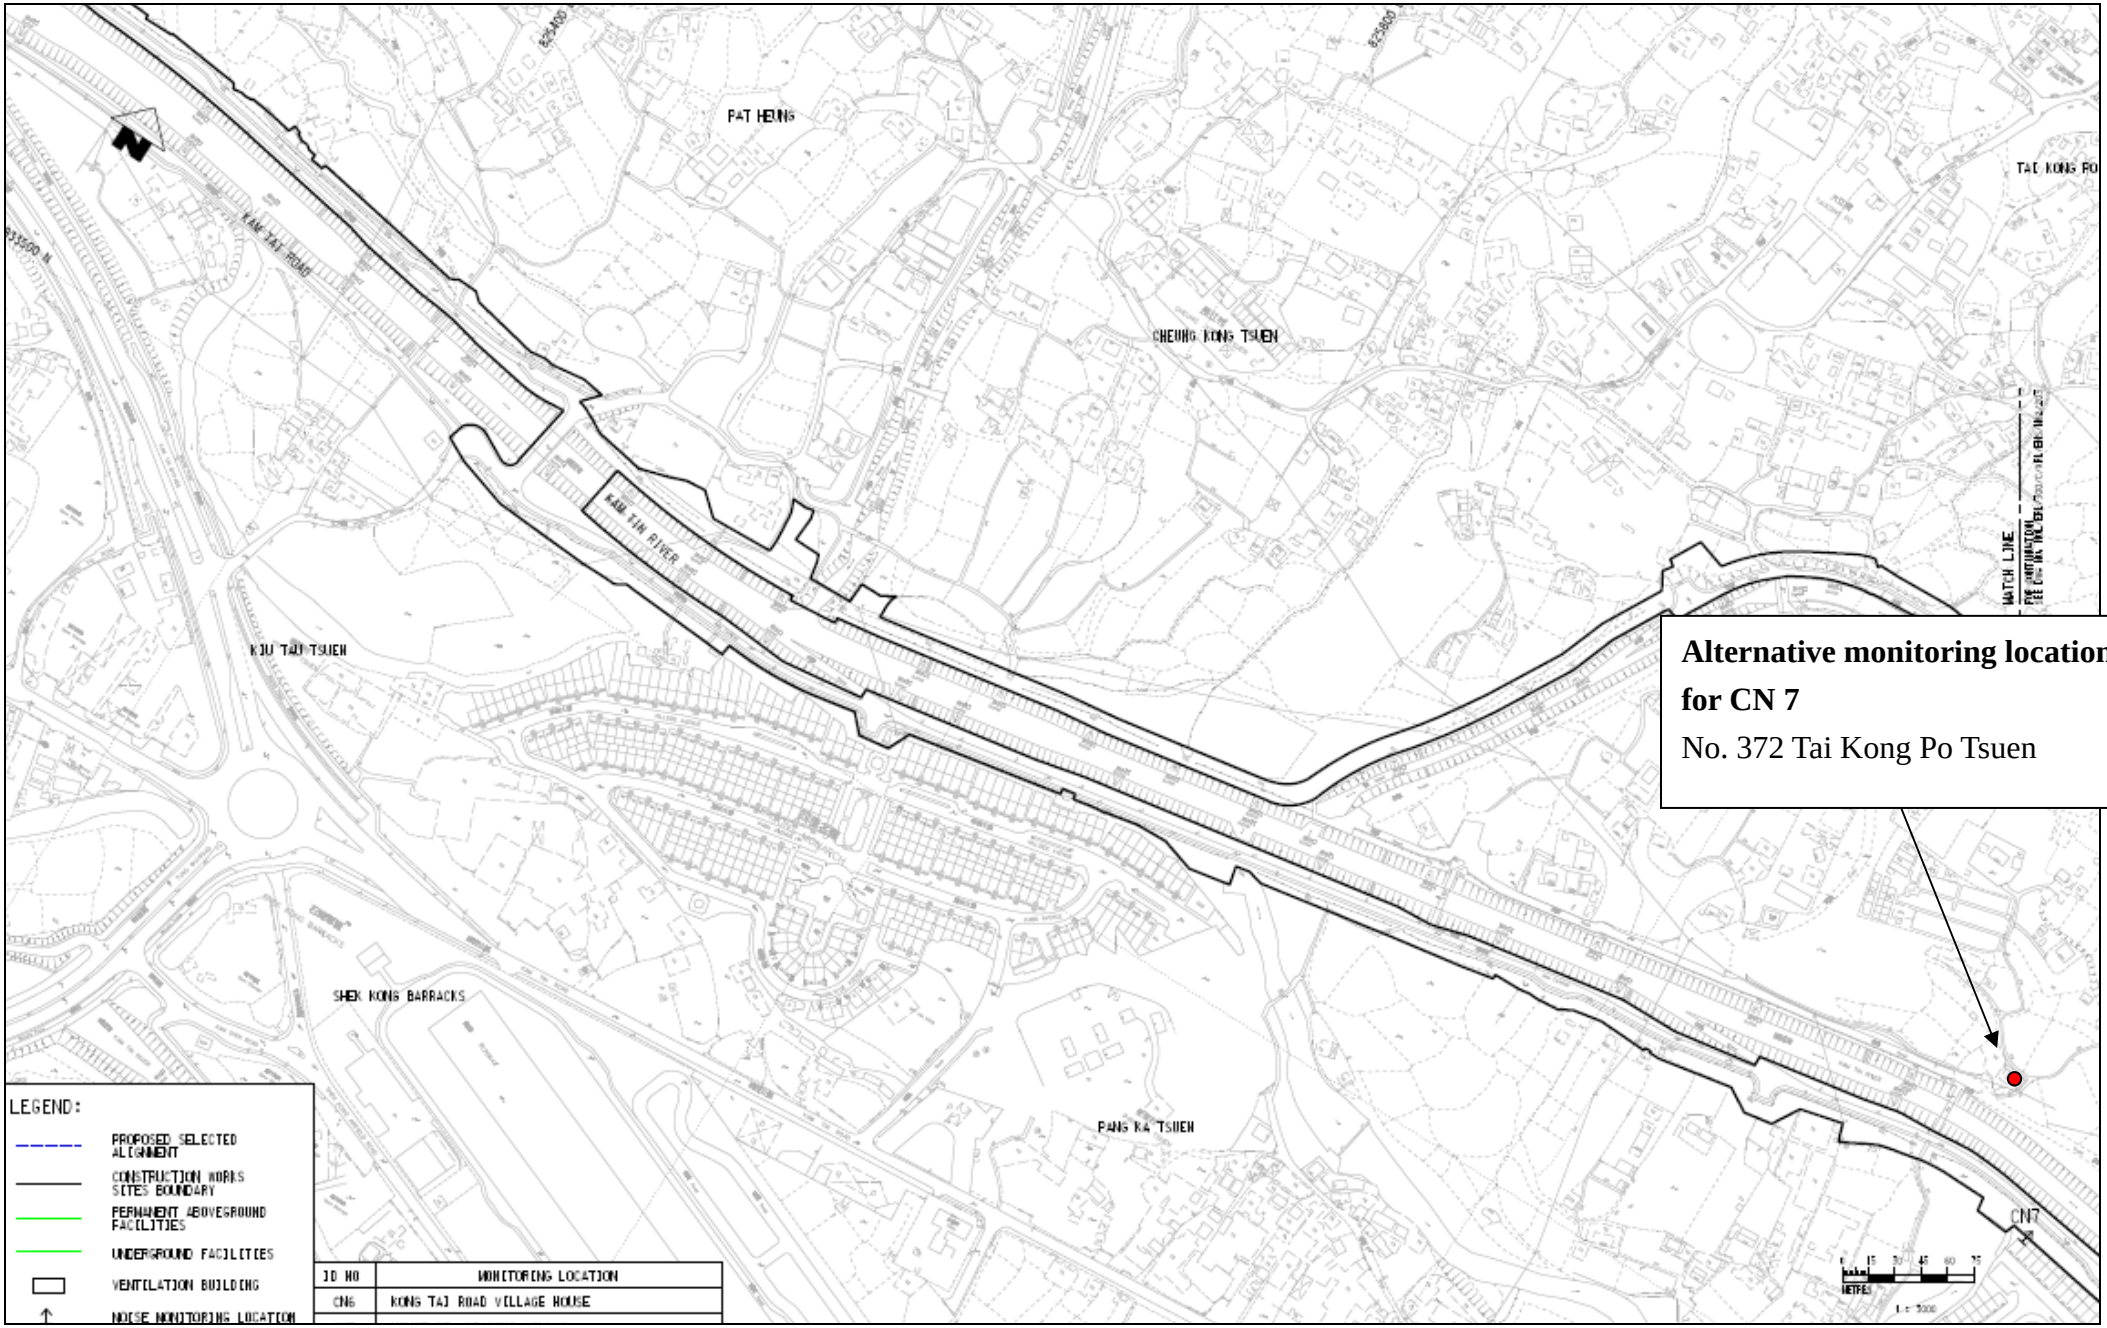


Figure 2 – Noise Monitoring Locations



Alternative monitoring location for CN 9
Leung Uk Tsuen Village House
EMERGENCY RESCUE STATION
LEUNG UK TSUEN
CN9
CN8
CN10
CN7
E.R HOLDING AREA
ACCESS ROAD
MAINTENANCE SHED
S.K.S. MAIN BLDG
GATE HOUSE
TRACTION P.(CLP)
CAR PARK
KENNEL
SHEK KONG STABLING SIDINGS
LAY DOWN AREA
CIVIL/BUILDING E&M
OHL BUILDING
PLANT ROOM
SIGNALING B.
PERMANENT W.
LAY DOWN AREA
RW01
RW02
RW03
D.G.S.
COCO BLDG
DIESEL S.
KAM TAI ROAD
KAM TIN RIVER
KAM TIN ROAD
CHURCH
PETROL STATION
WORK SHOP
SHEK KONG BARRACKS (PLA)
SPORTS GROUND
MATCH LINE
826800 E
826400 E
833600 N
833200 N
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
NOISE MONITORING LOCATION
METRES
1 : 3000
ID NO | MONITORING LOCATION
CN7 | HOUSE93, SEASONS VILLAS
CN8 | DD110 LOT 482, WANG TOI SHAN
CN9 | LEUNG UK TSUEN VILLAGE HOUSE
CN10 | LEUNG UK TSUEN SQUATS

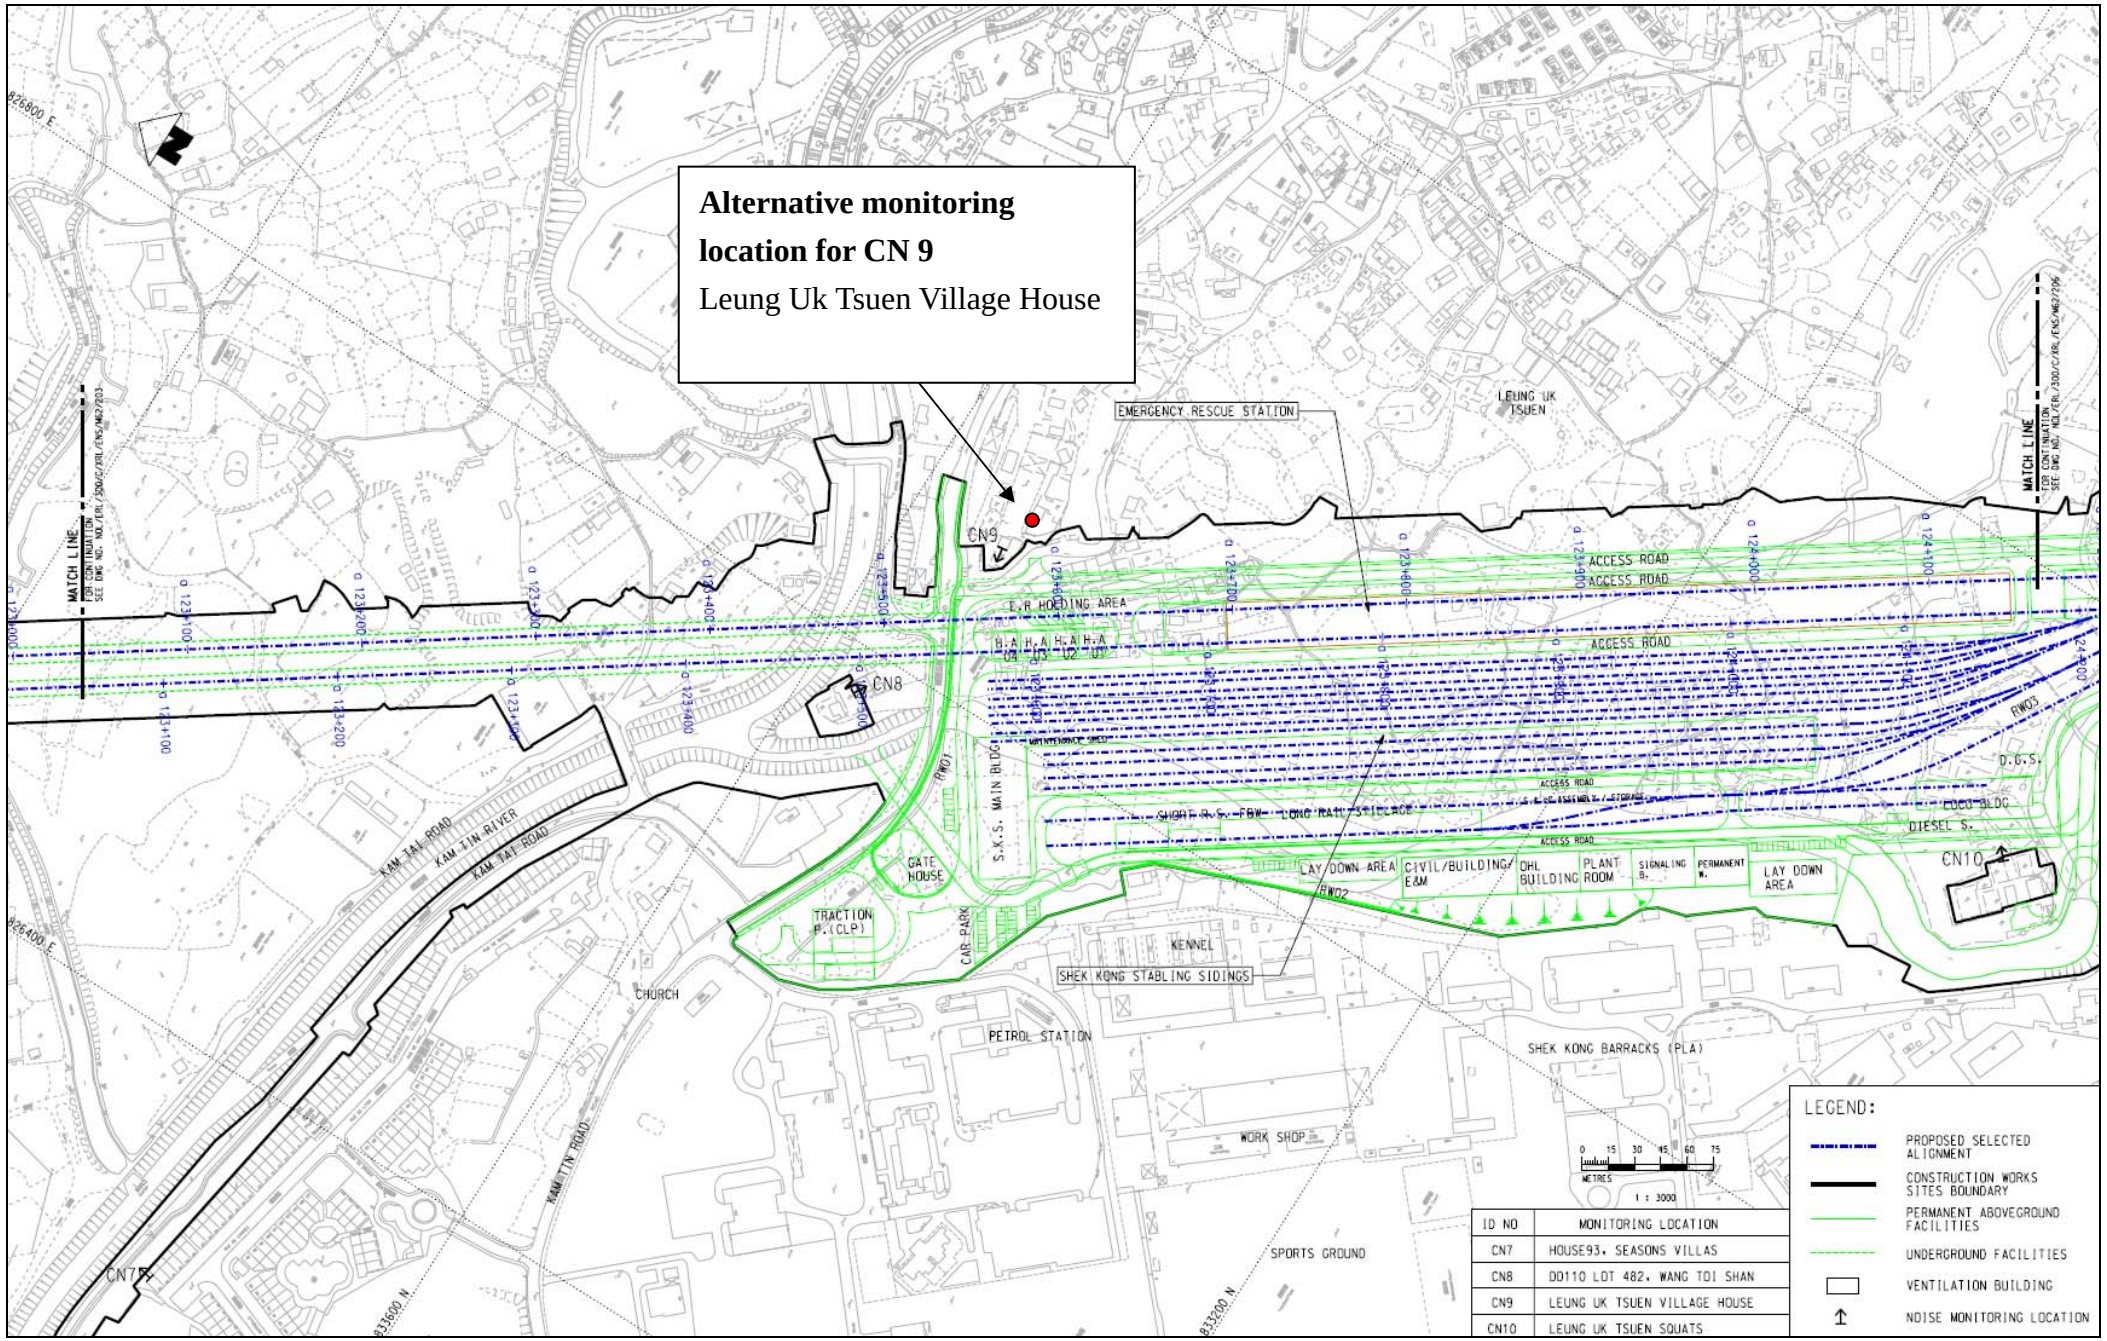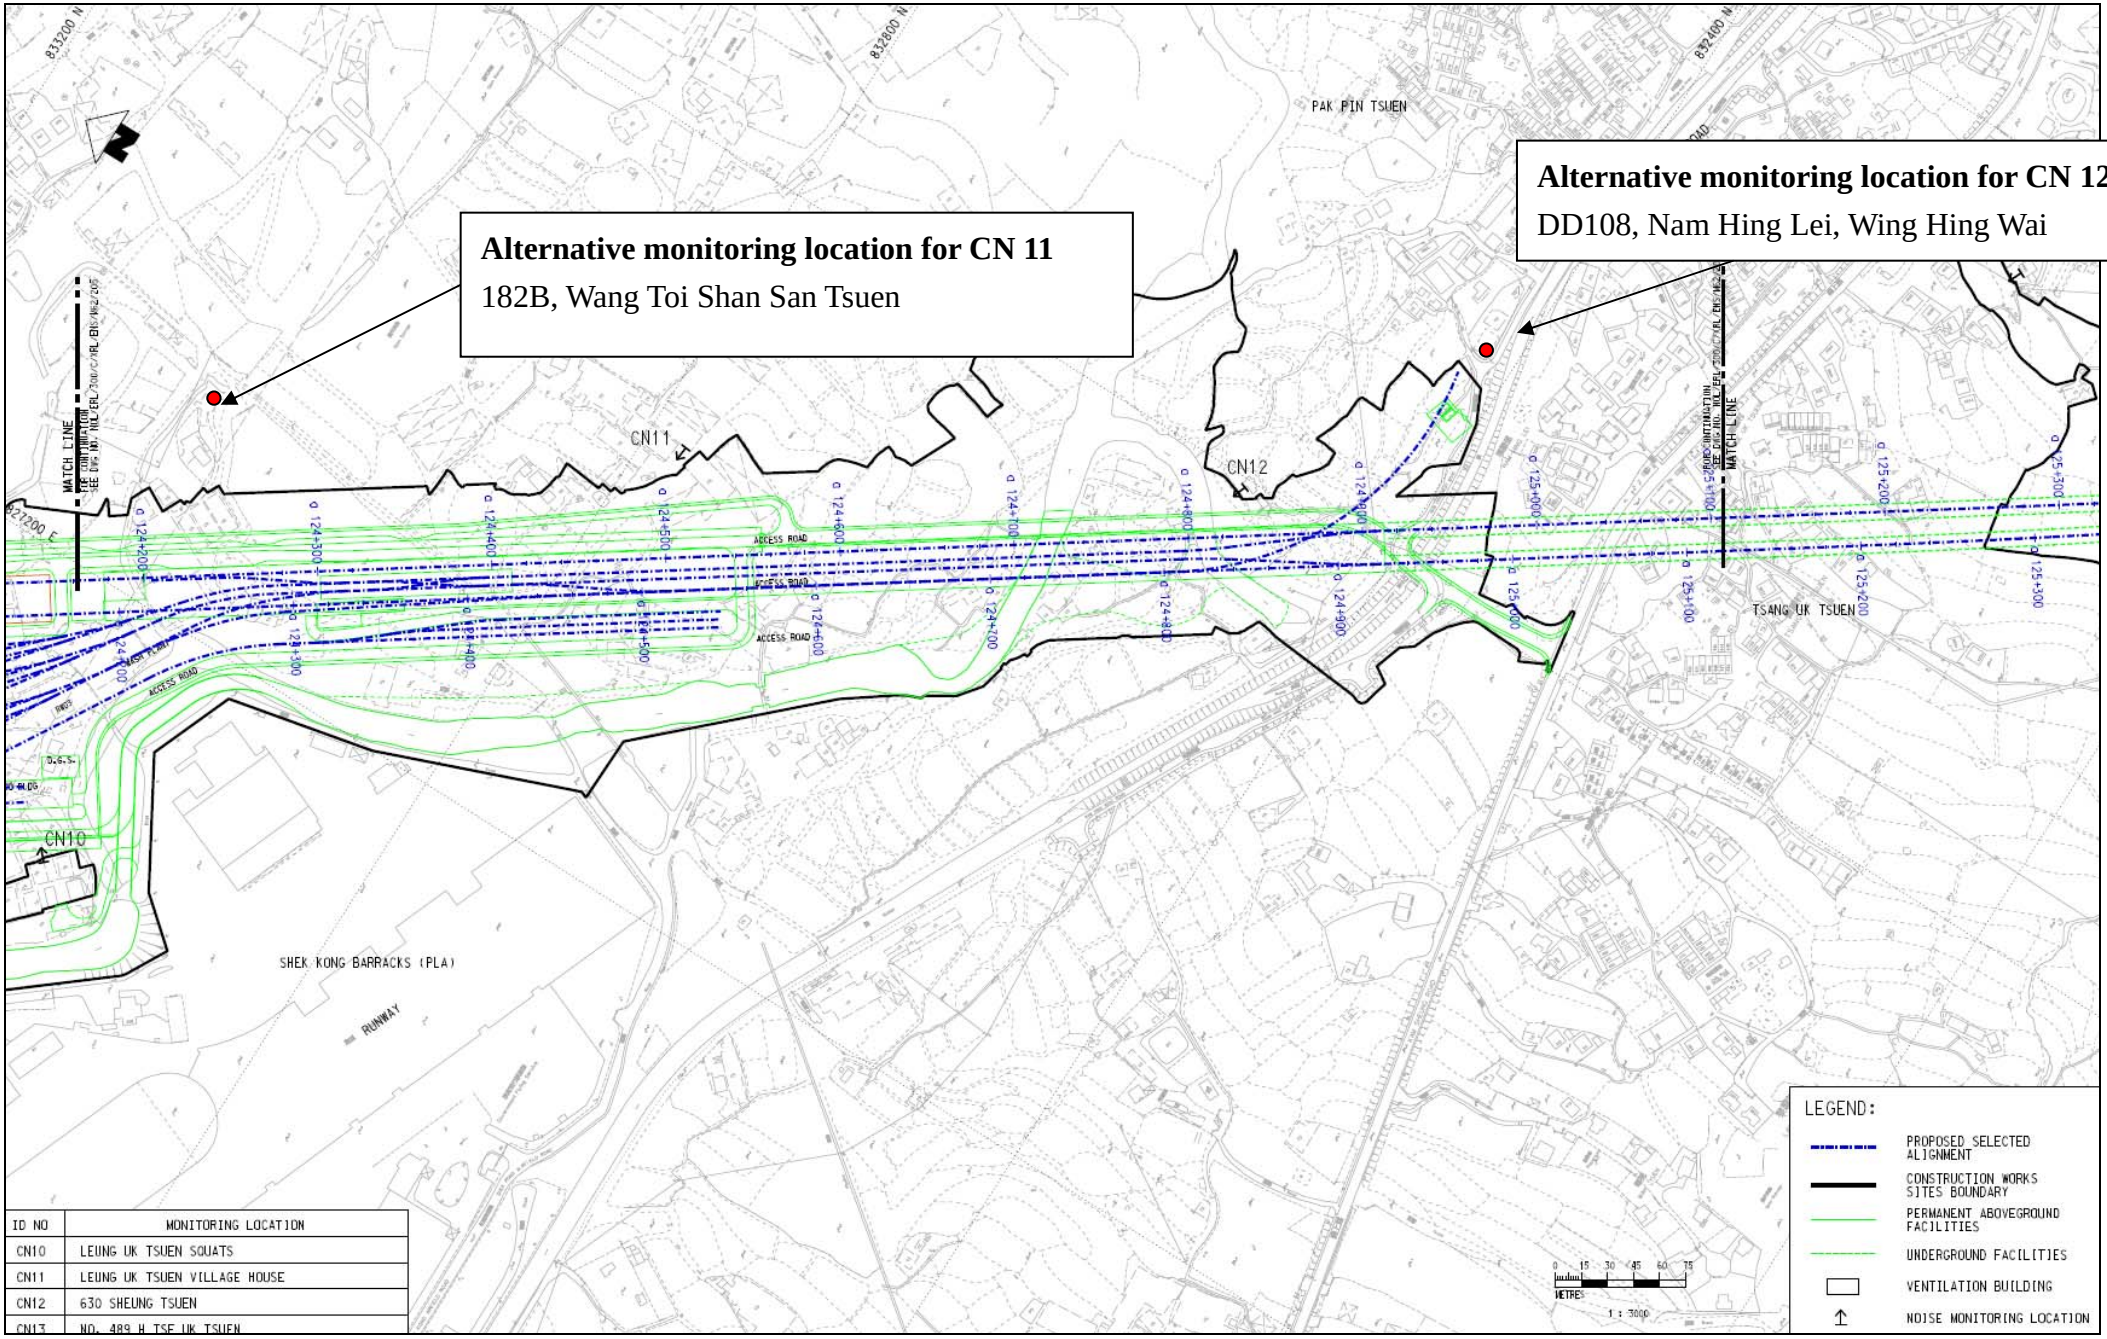

ID NO	MONITORING LOCATION
CN10	LEUNG UK TSUEN SQUATS
CN11	LEUNG UK TSUEN VILLAGE HOUSE
CN12	630 SHEUNG TSUEN
CN13	NO. 489 H TSE UK TSUEN

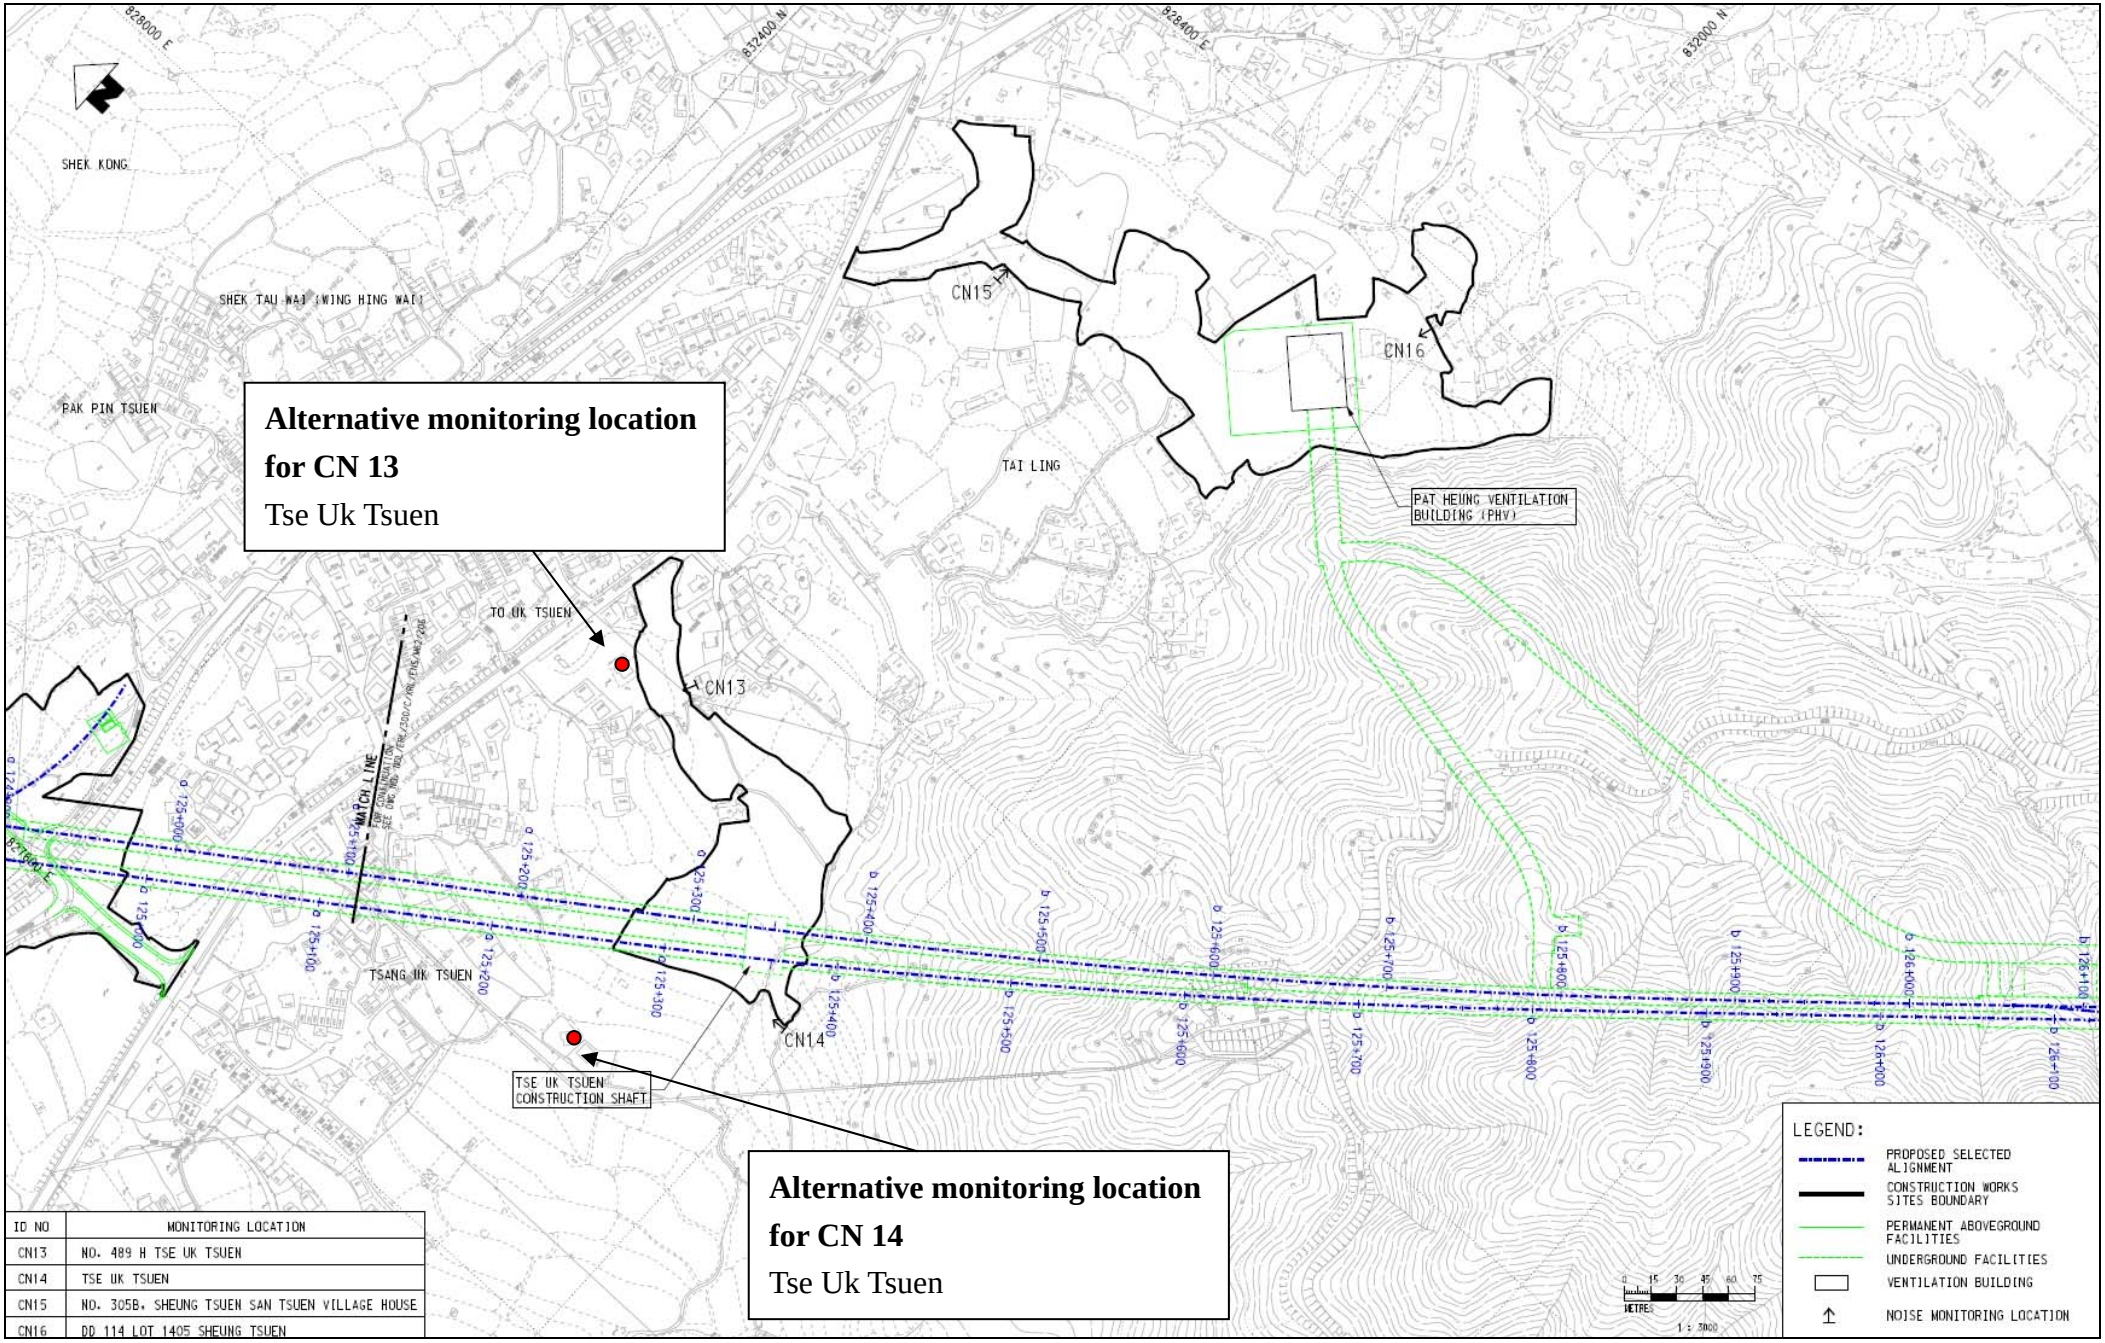

ID NO	MONITORING LOCATION
CN13	NO. 489 H TSE UK TSUEN
CN14	TSE UK TSUEN
CN15	NO. 305B, SHEUNG TSUEN SAN TSUEN VILLAGE HOUSE
CN16	DD 114 LOT 1405 SHEUNG TSUEN

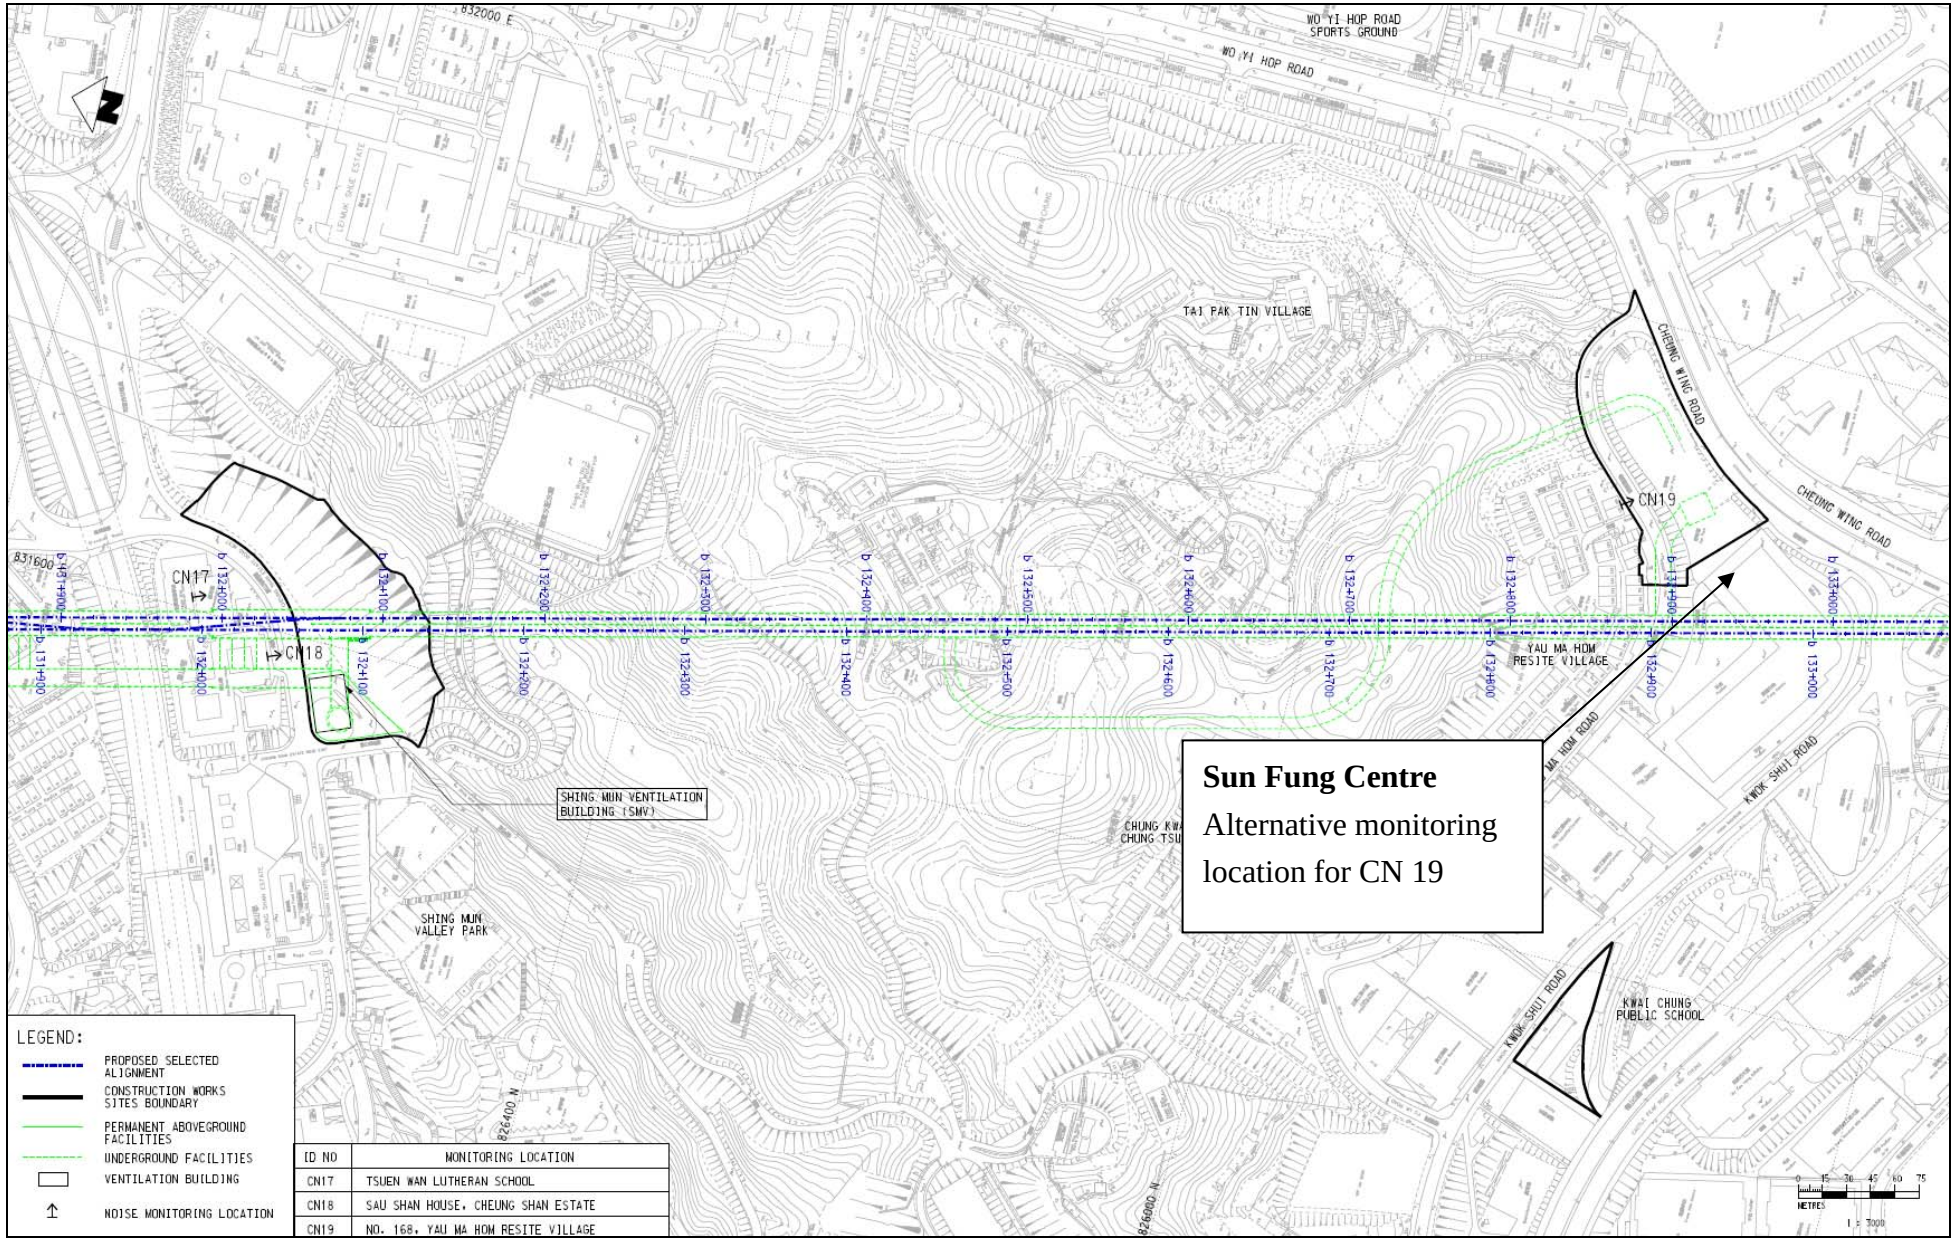
832000 E
WO YI HOP ROAD SPORTS GROUND
WO YI HOP ROAD
TAI PAK TIN VILLAGE
CHEUNG WING ROAD
CHEUNG WING ROAD
CN19
CN17
CN18
831600
SHING MUN VENTILATION BUILDING (SMV)
SHING MUN VALLEY PARK
YAU MA HOM RESITE VILLAGE
MA HOM ROAD
KWOK SHUI ROAD
KWOK SHUI ROAD
KWAI CHUNG PUBLIC SCHOOL
826400 N
826000 N
METRES
1 : 7000
Sun Fung Centre
Alternative monitoring location for CN 19
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
NOISE MONITORING LOCATION
ID NO | MONITORING LOCATION
CN17 | TSUEN WAN LUTHERAN SCHOOL
CN18 | SAU SHAN HOUSE, CHEUNG SHAN ESTATE
CN19 | NO. 168, YAU MA HOM RESITE VILLAGE



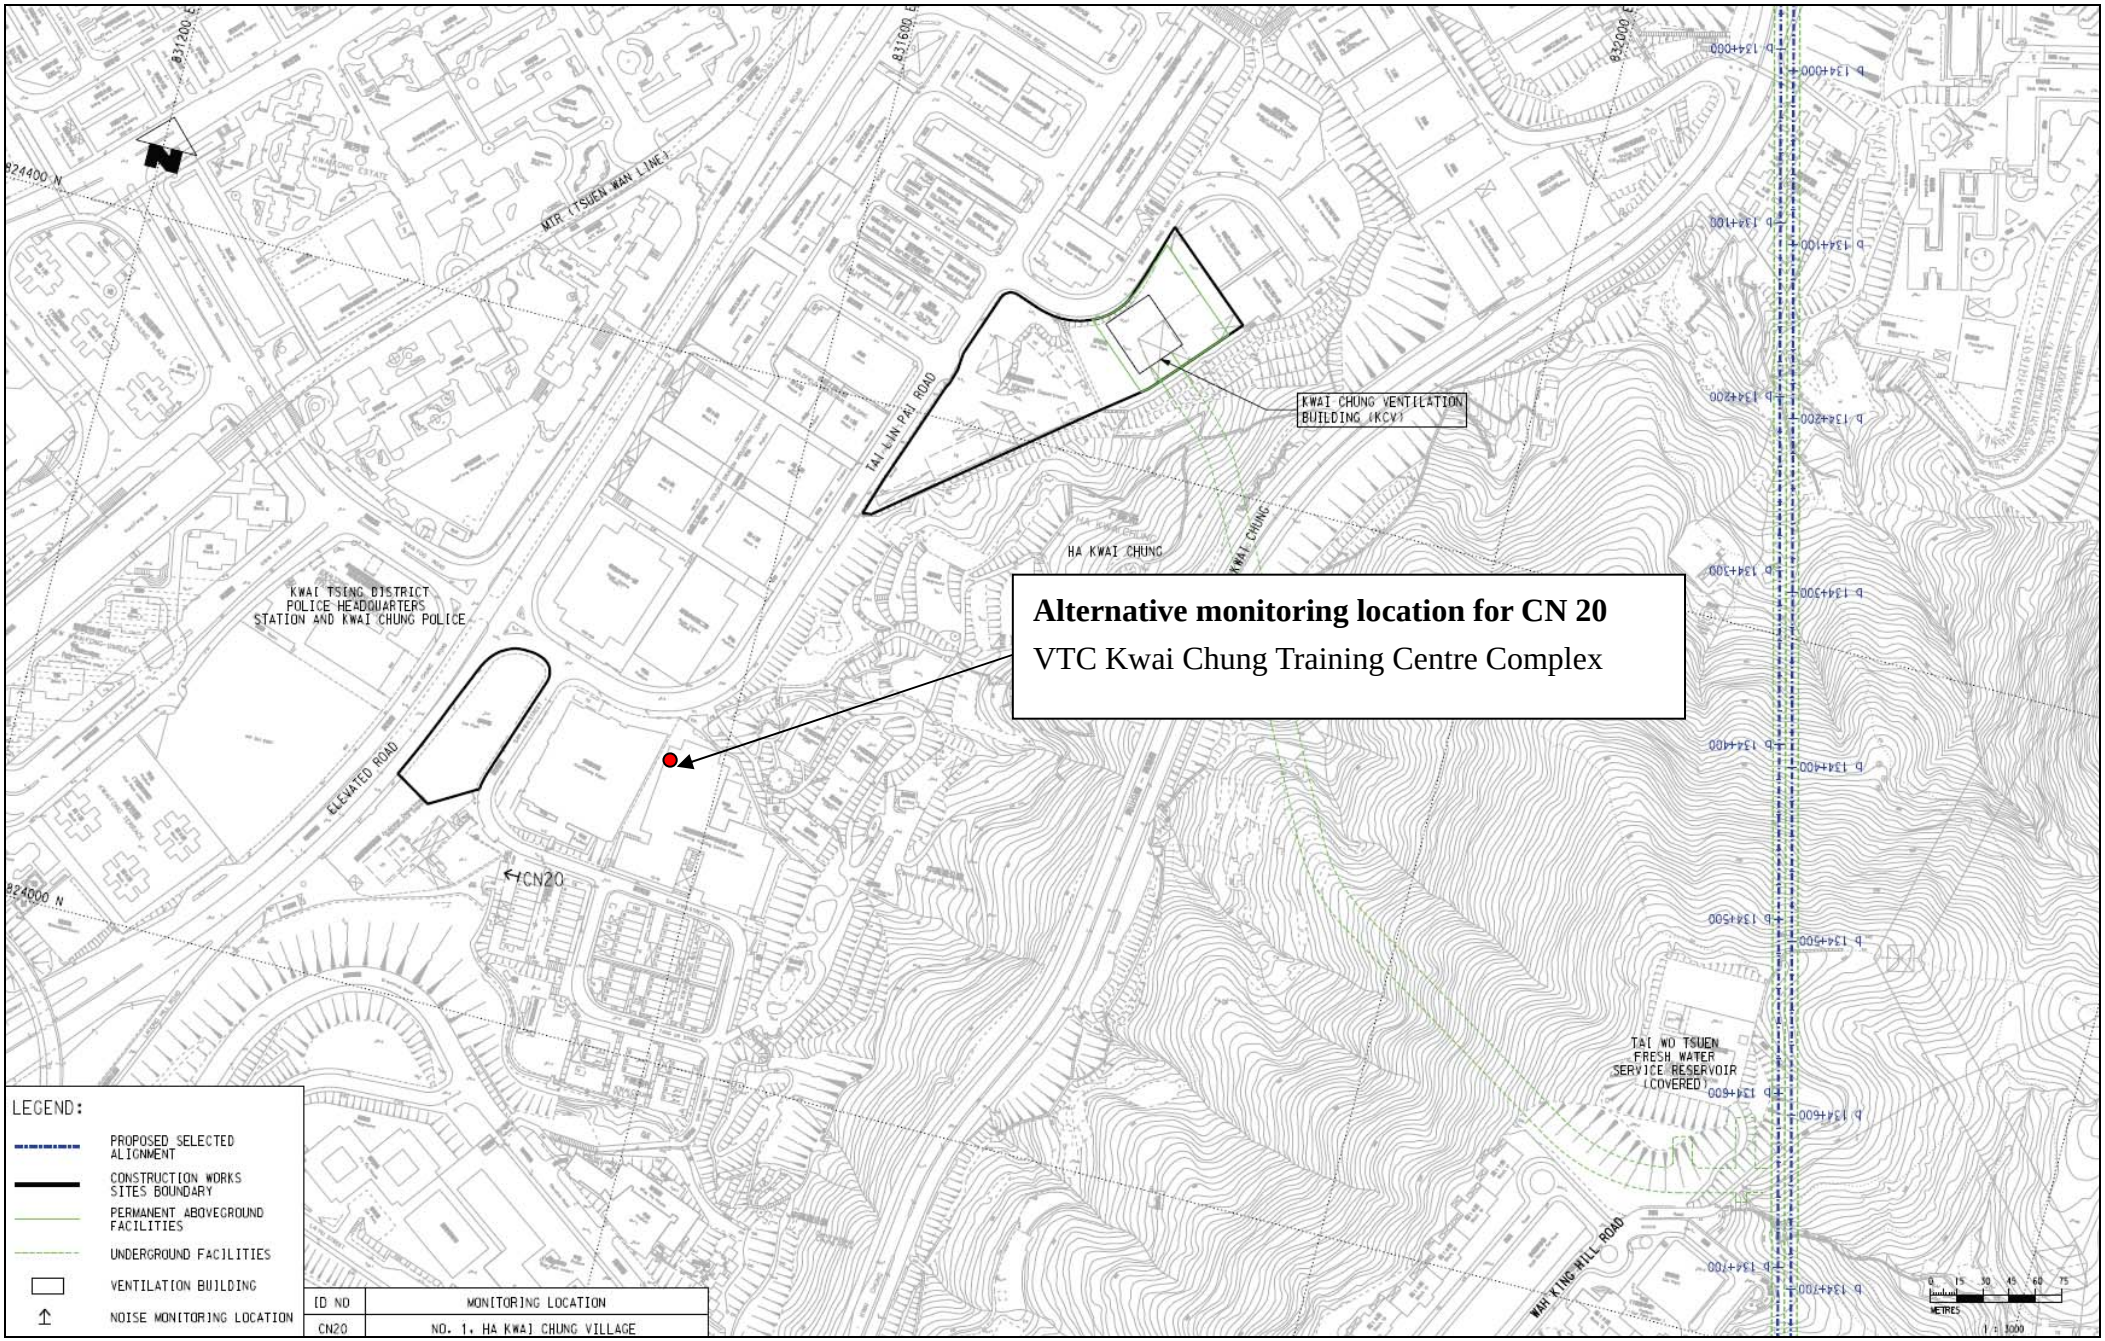



Figure 3 – Noise Monitoring Location

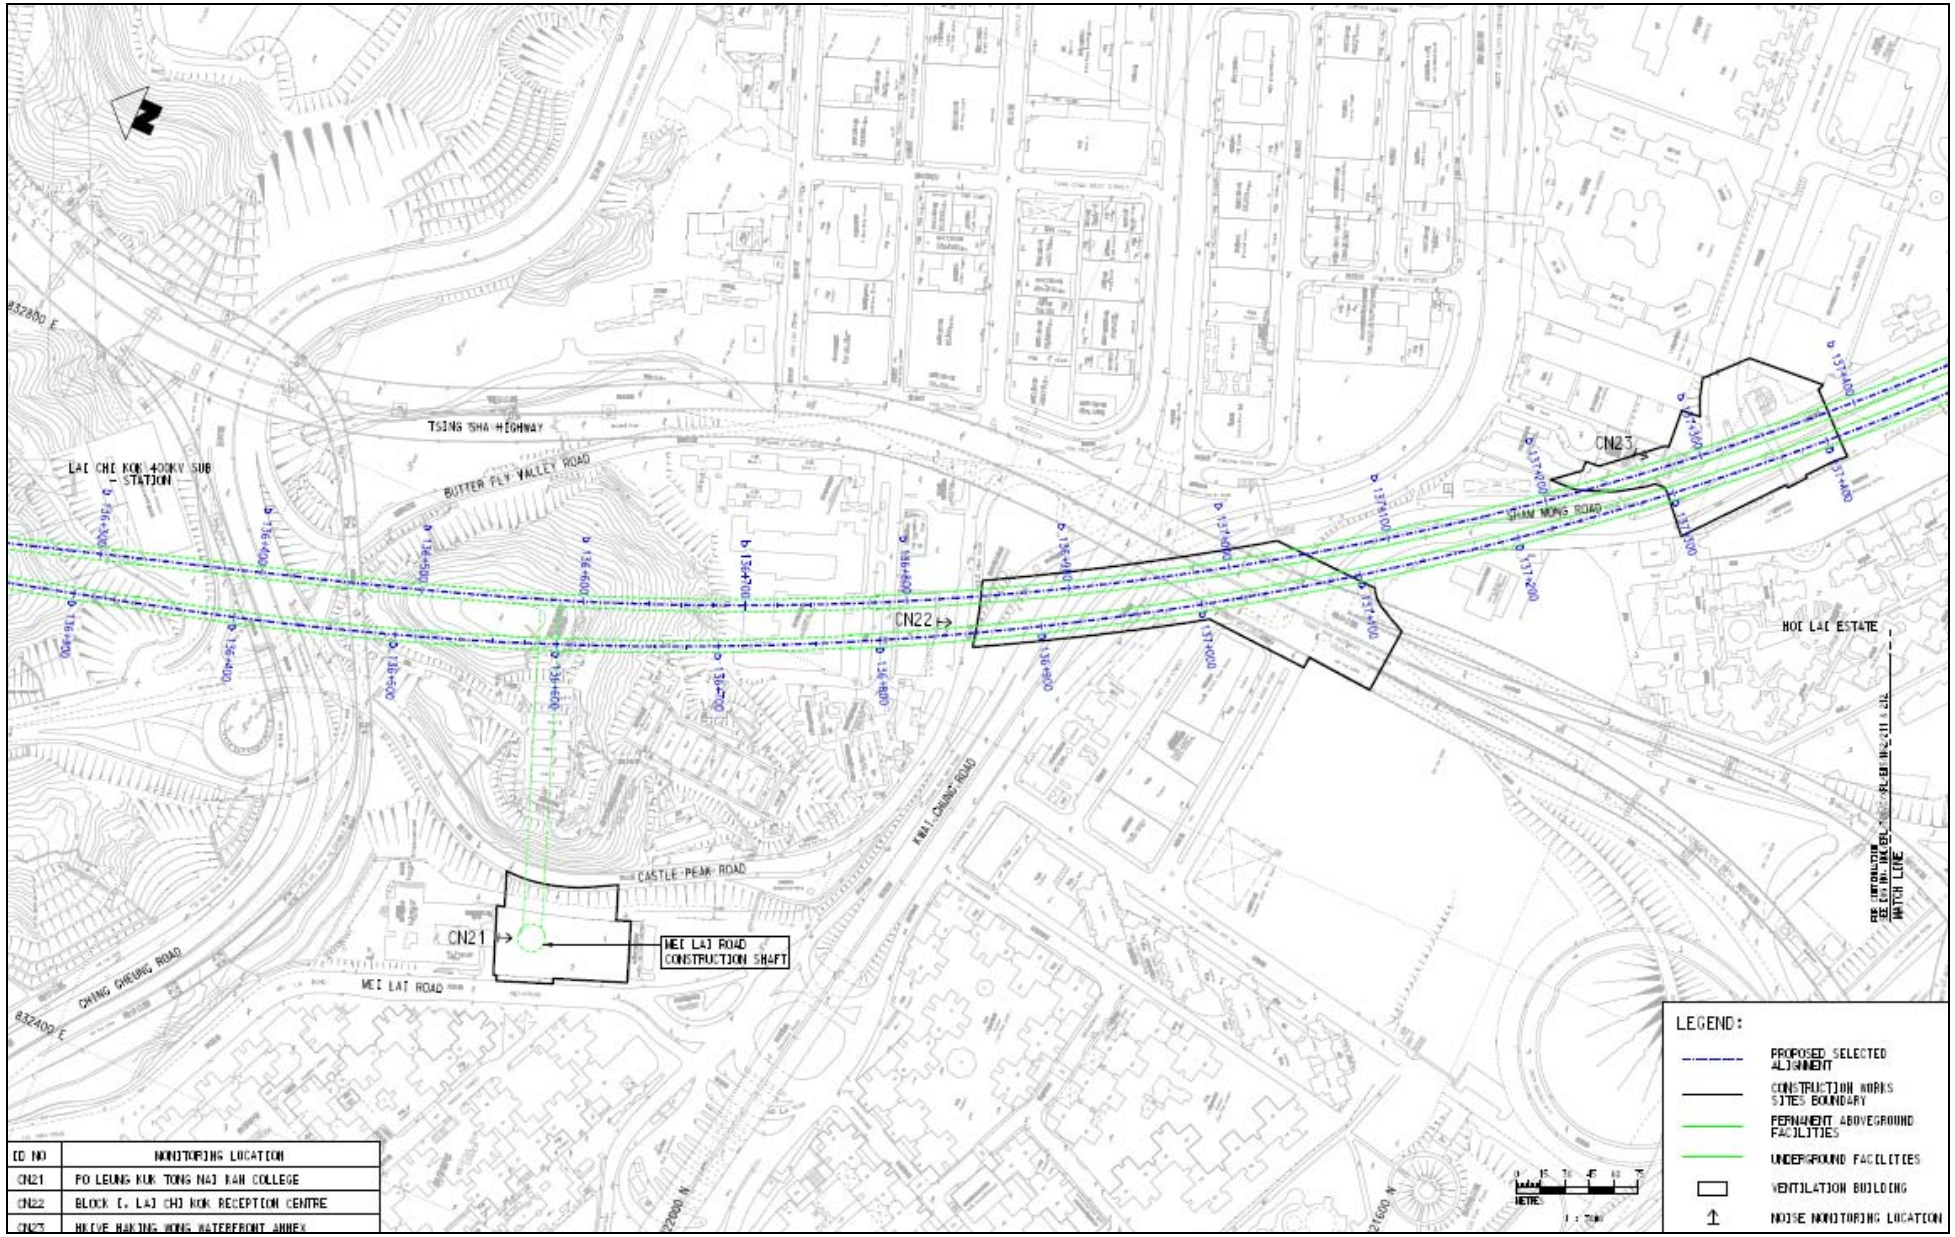


ID NO	MONITORING LOCATION
CN21	PO LEUNG KUK TONG NAI RAN COLLEGE
CN22	BLOCK C, LAI CHI KOK RECEPTION CENTRE
CN23	HOLYE HAKKING WONG WATERFRONT ANNEX

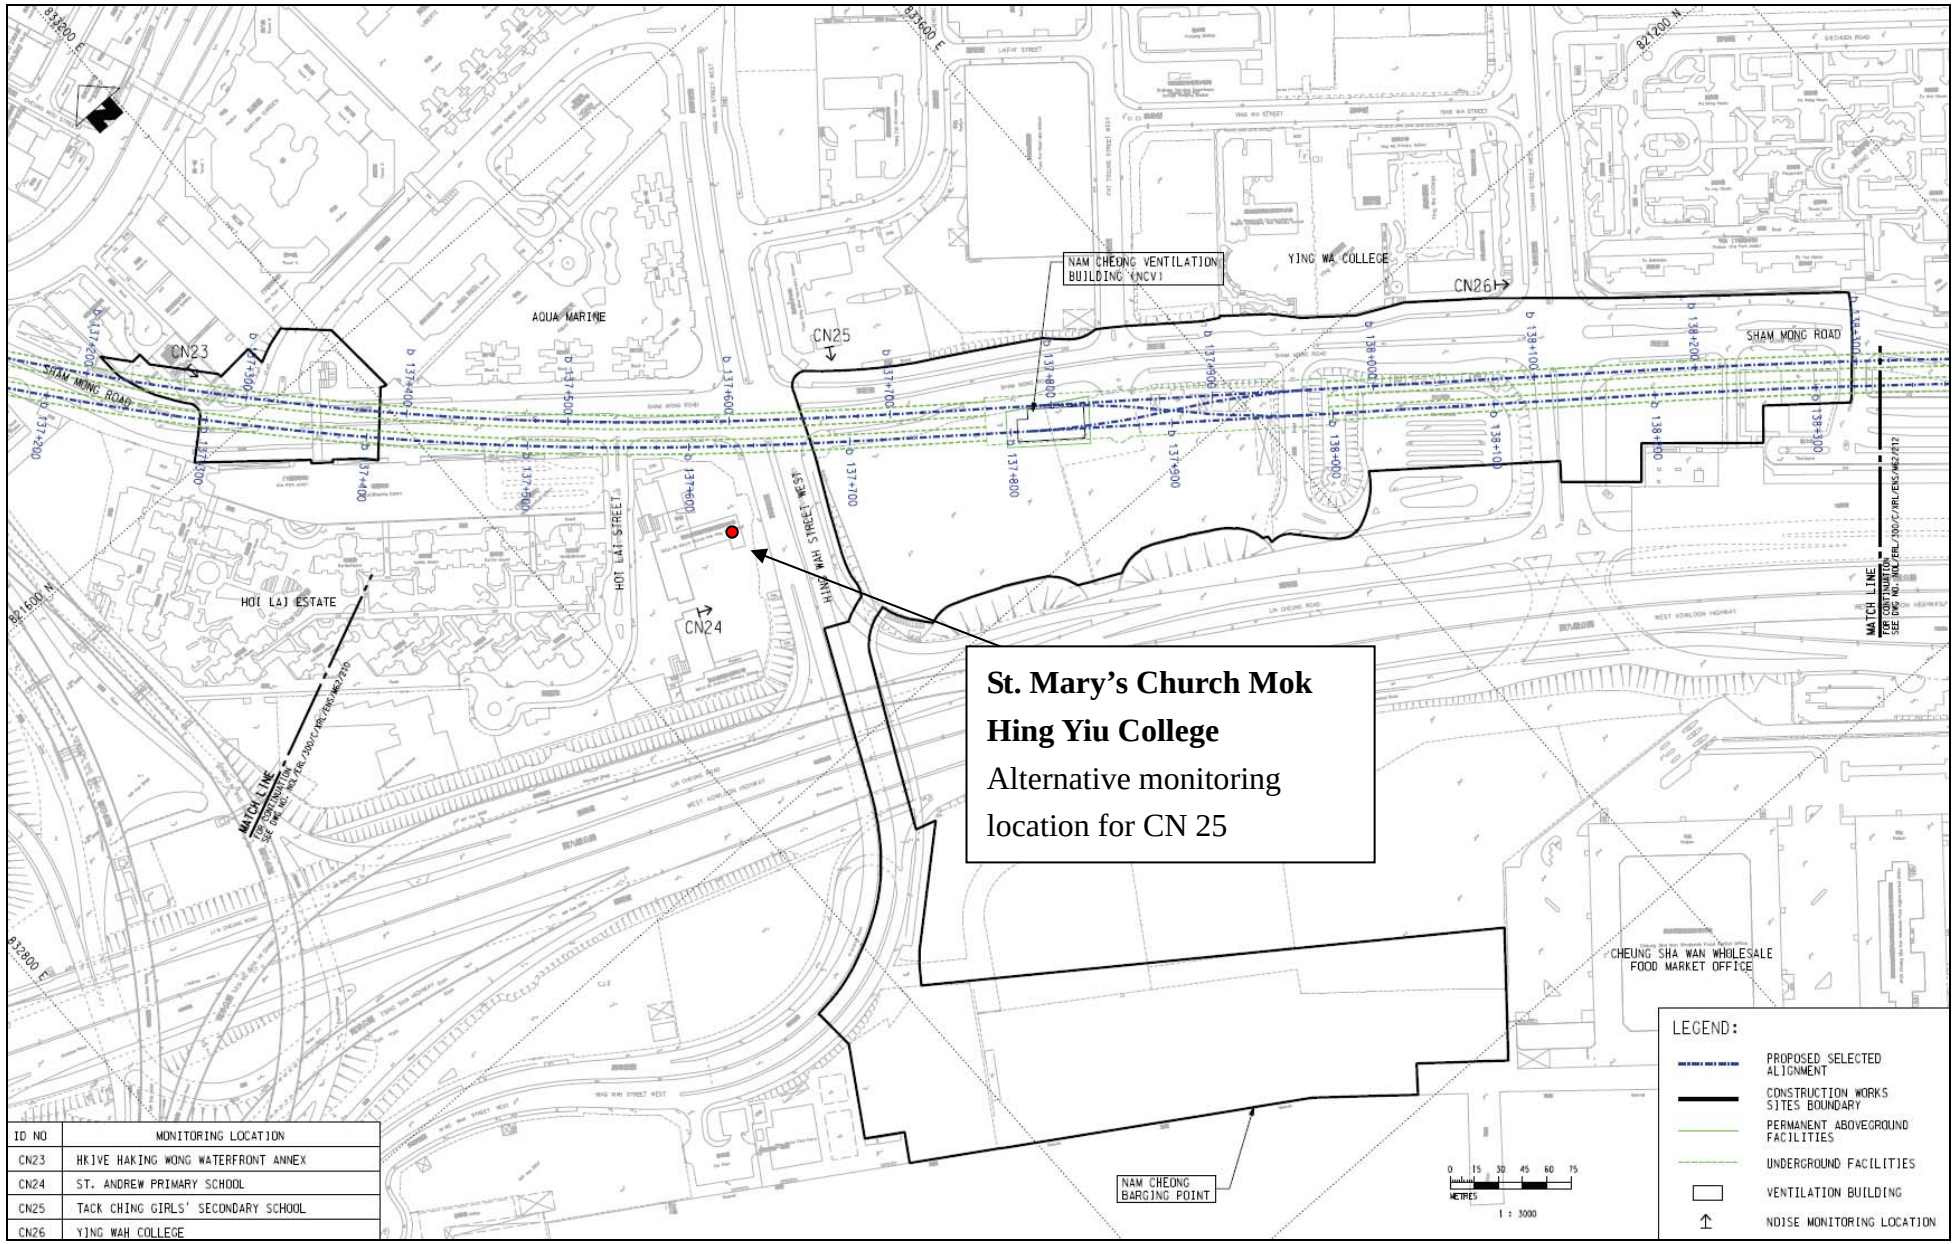


ID NO	MONITORING LOCATION
CN23	HKIVE HAKING WONG WATERFRONT ANNEX
CN24	ST. ANDREW PRIMARY SCHOOL
CN25	TACK CHING GIRLS' SECONDARY SCHOOL
CN26	YING WAH COLLEGE

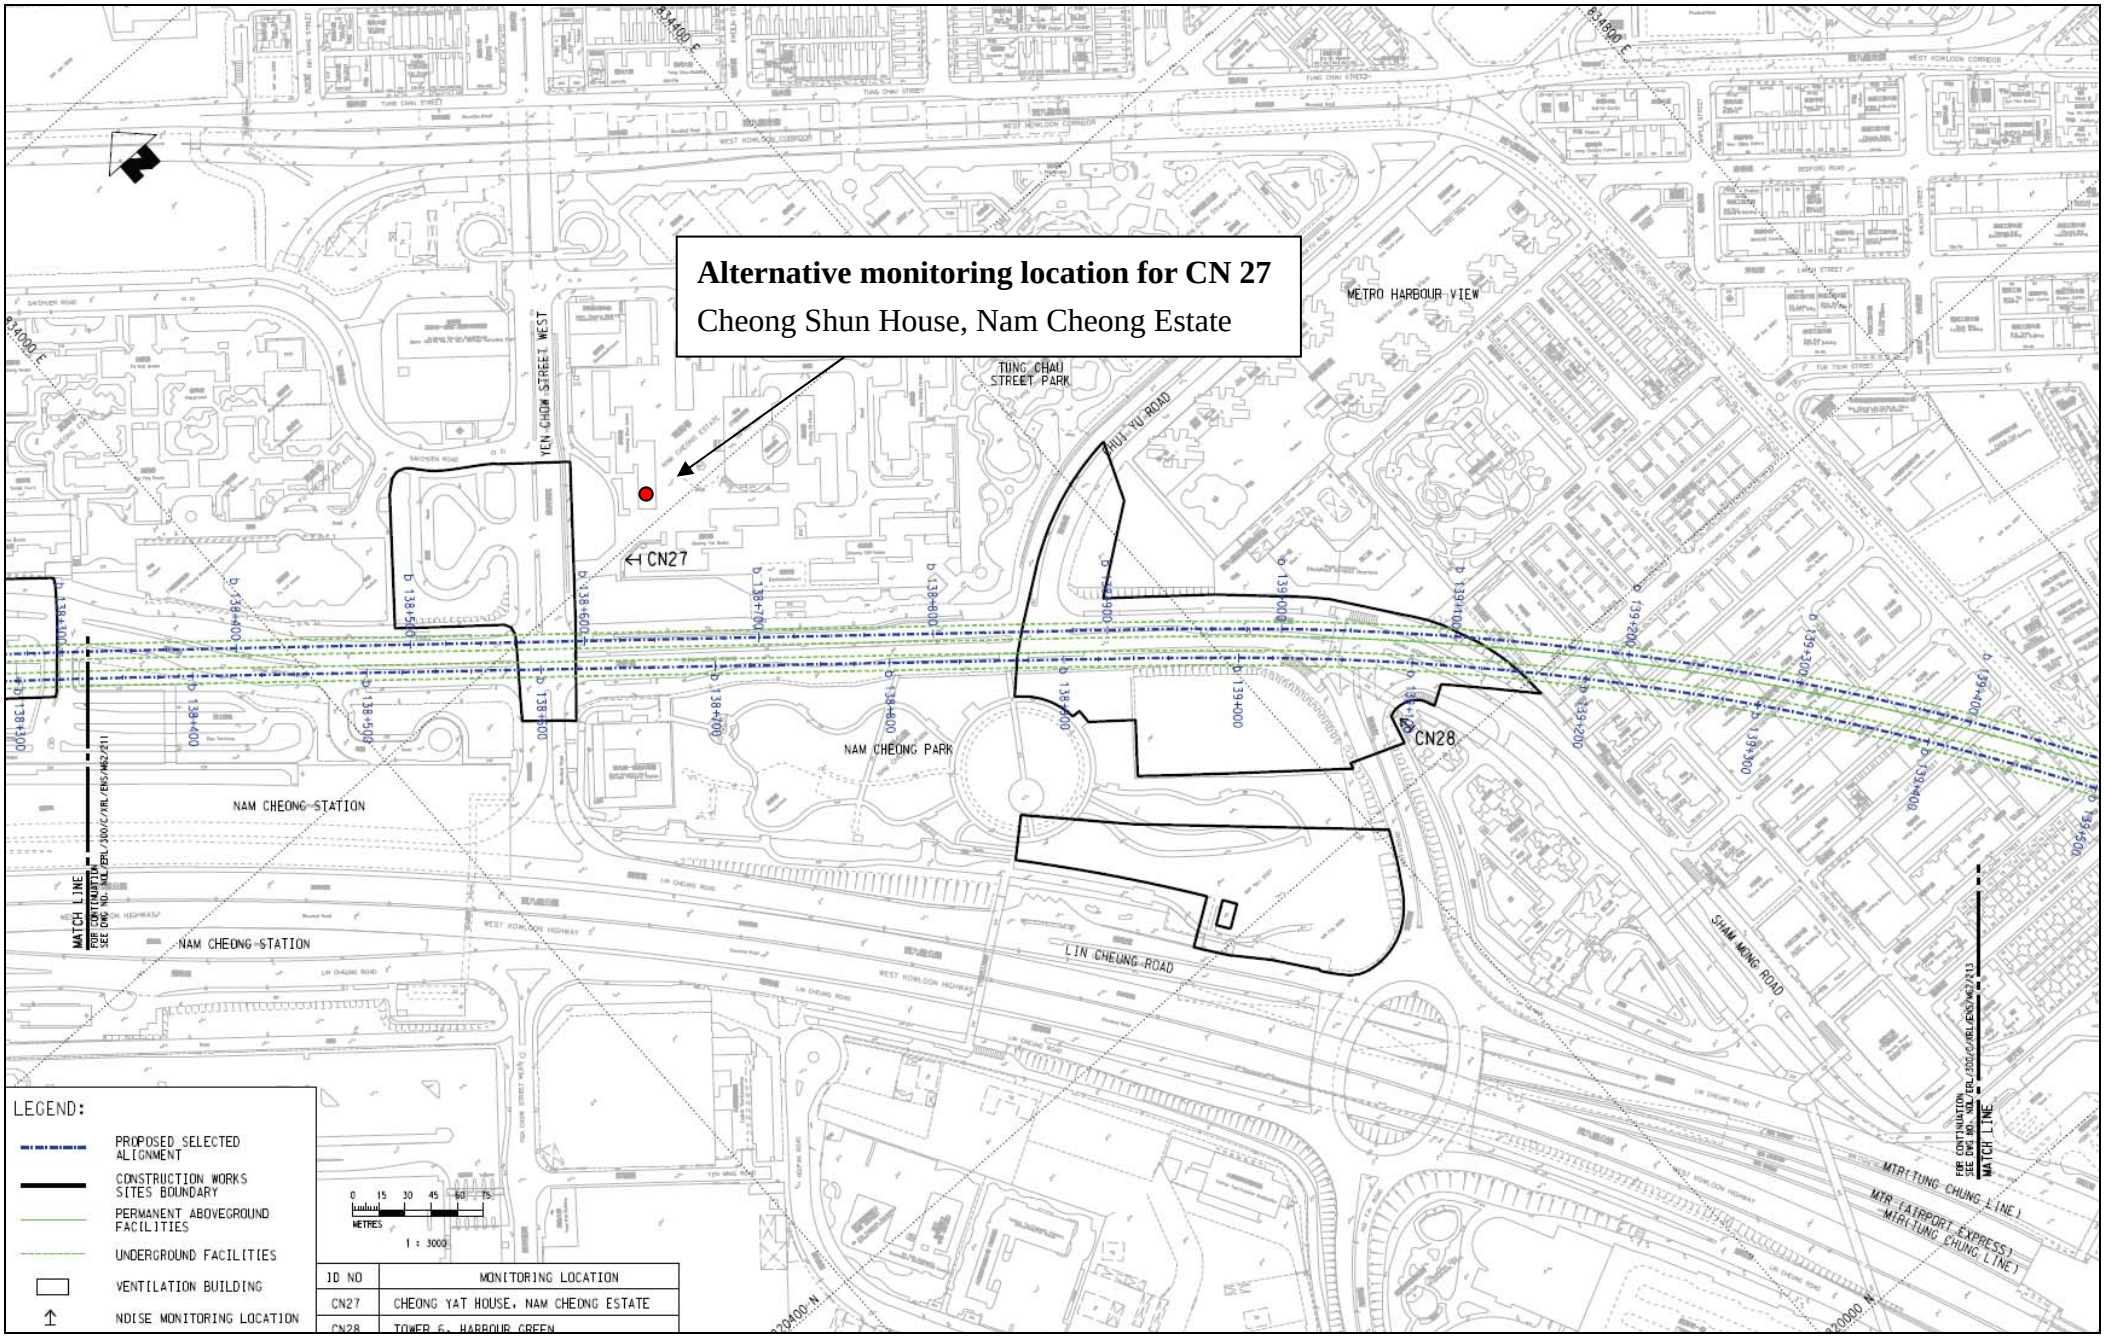

Alternative monitoring location for CN 27
Cheong Shun House, Nam Cheong Estate
CN27
CN28
NAM CHEONG PARK
NAM CHEONG STATION
NAM CHEONG STATION
TUNG CHAU STREET PARK
METRO HARBOUR VIEW
YEN CHOW STREET WEST
HUI YU ROAD
LIN CHEUNG ROAD
SHAM MONG ROAD
WEST KOWLOON HIGHWAY
MATCH LINE
FOR CONTINUATION SEE DWG NO. XOL/EBL/300/C/XRL/ENS/MW2/2411
MATCH LINE
FOR CONTINUATION SEE DWG NO. XOL/EBL/300/D/XRL/ENS/MW2/2413
MTR (TUNG CHUNG LINE)
MTR (AIRPORT EXPRESS)
MTR (TUNG CHUNG LINE)
LEGEND:
PROPOSED SELECTED ALIGNMENT
CONSTRUCTION WORKS SITES BOUNDARY
PERMANENT ABOVEGROUND FACILITIES
UNDERGROUND FACILITIES
VENTILATION BUILDING
NOISE MONITORING LOCATION
0 15 30 45 60 75
METRES
1 : 3000
ID NO
MONITORING LOCATION
CN27
CHEONG YAT HOUSE, NAM CHEONG ESTATE
CN28
TOWER 6, HARBOUR GREEN

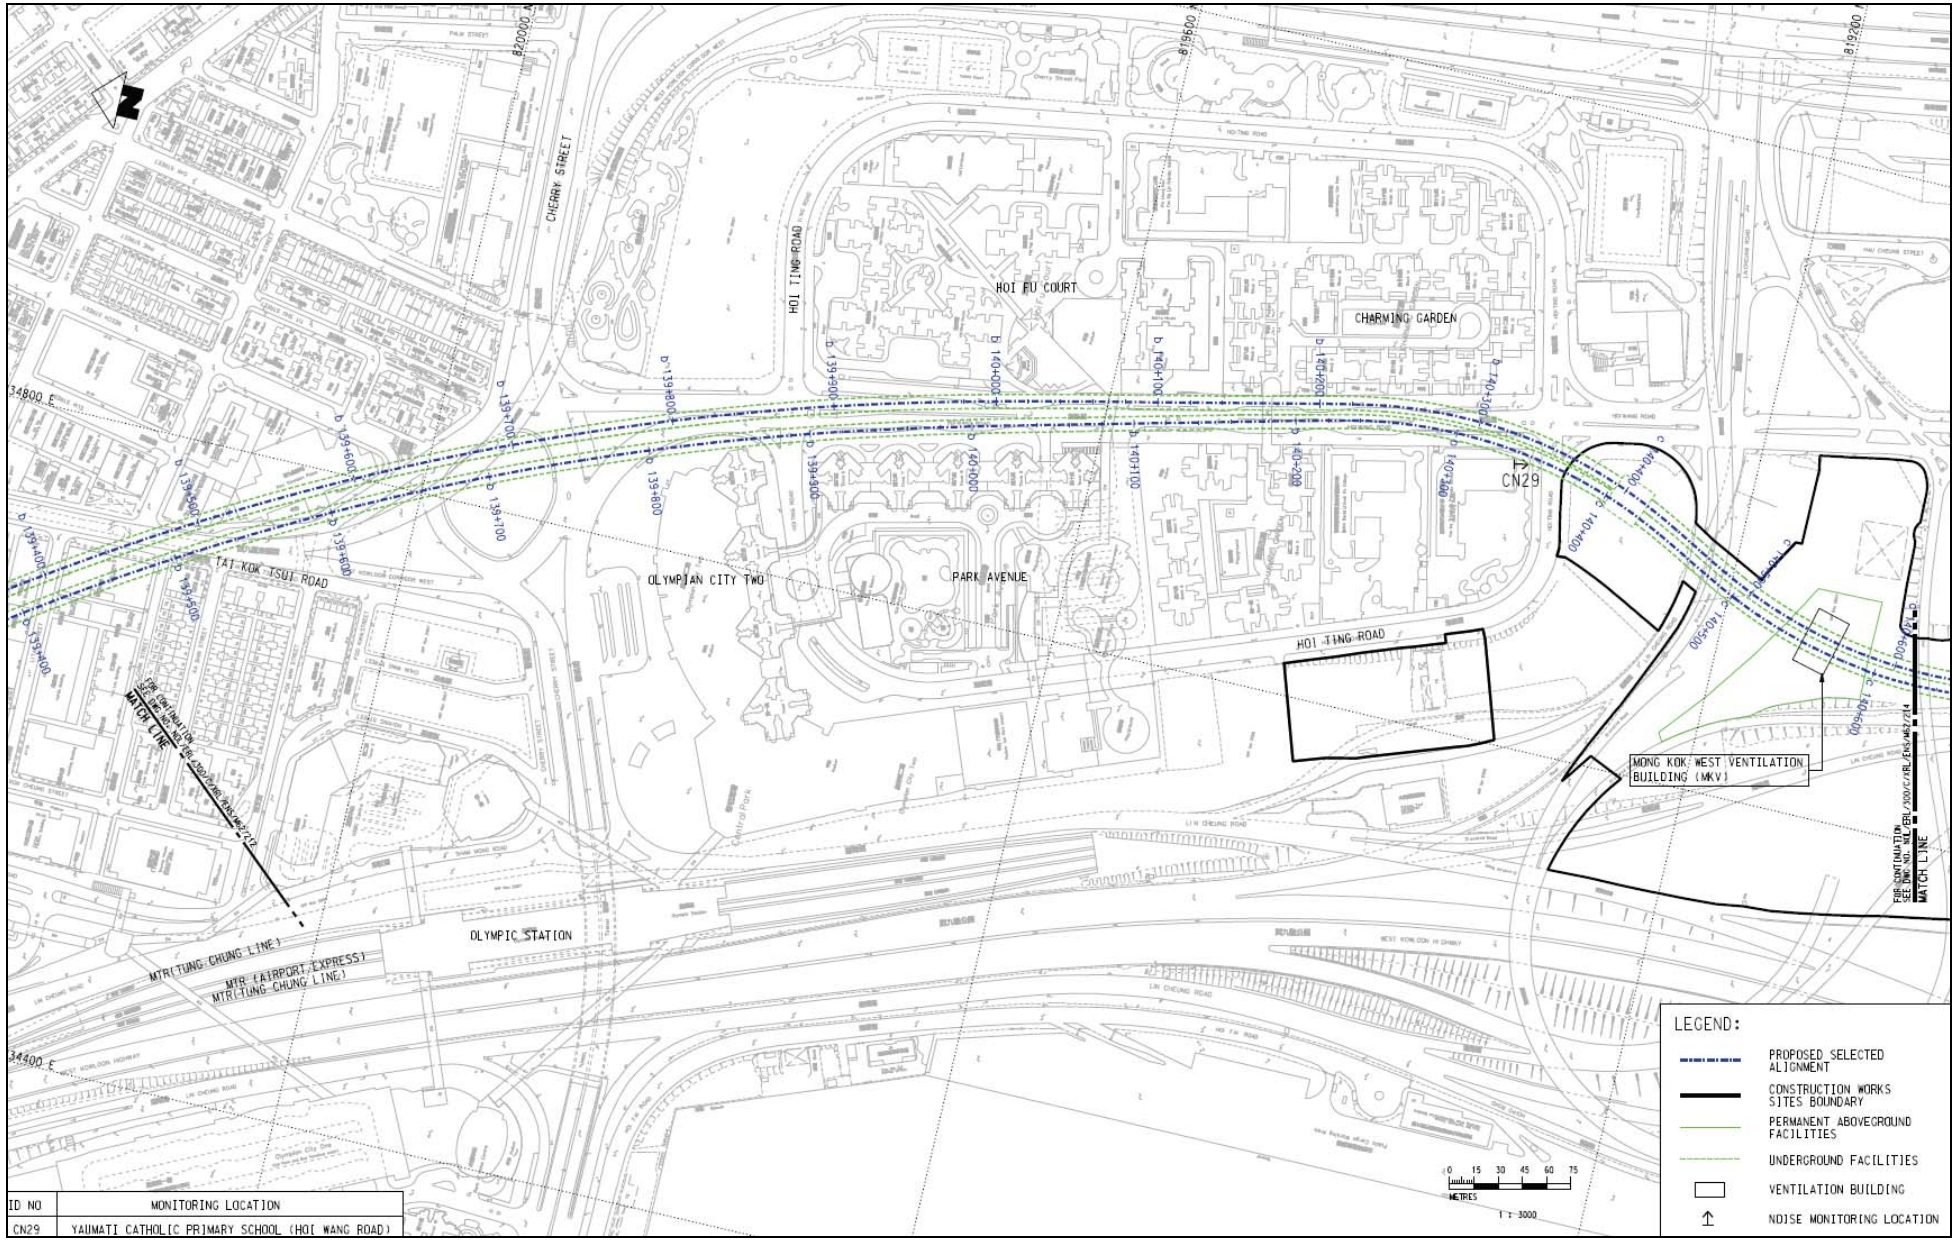

ID NO	MONITORING LOCATION
CN29	YAUMATI CATHOLIC PRIMARY SCHOOL (HOI WANG ROAD)

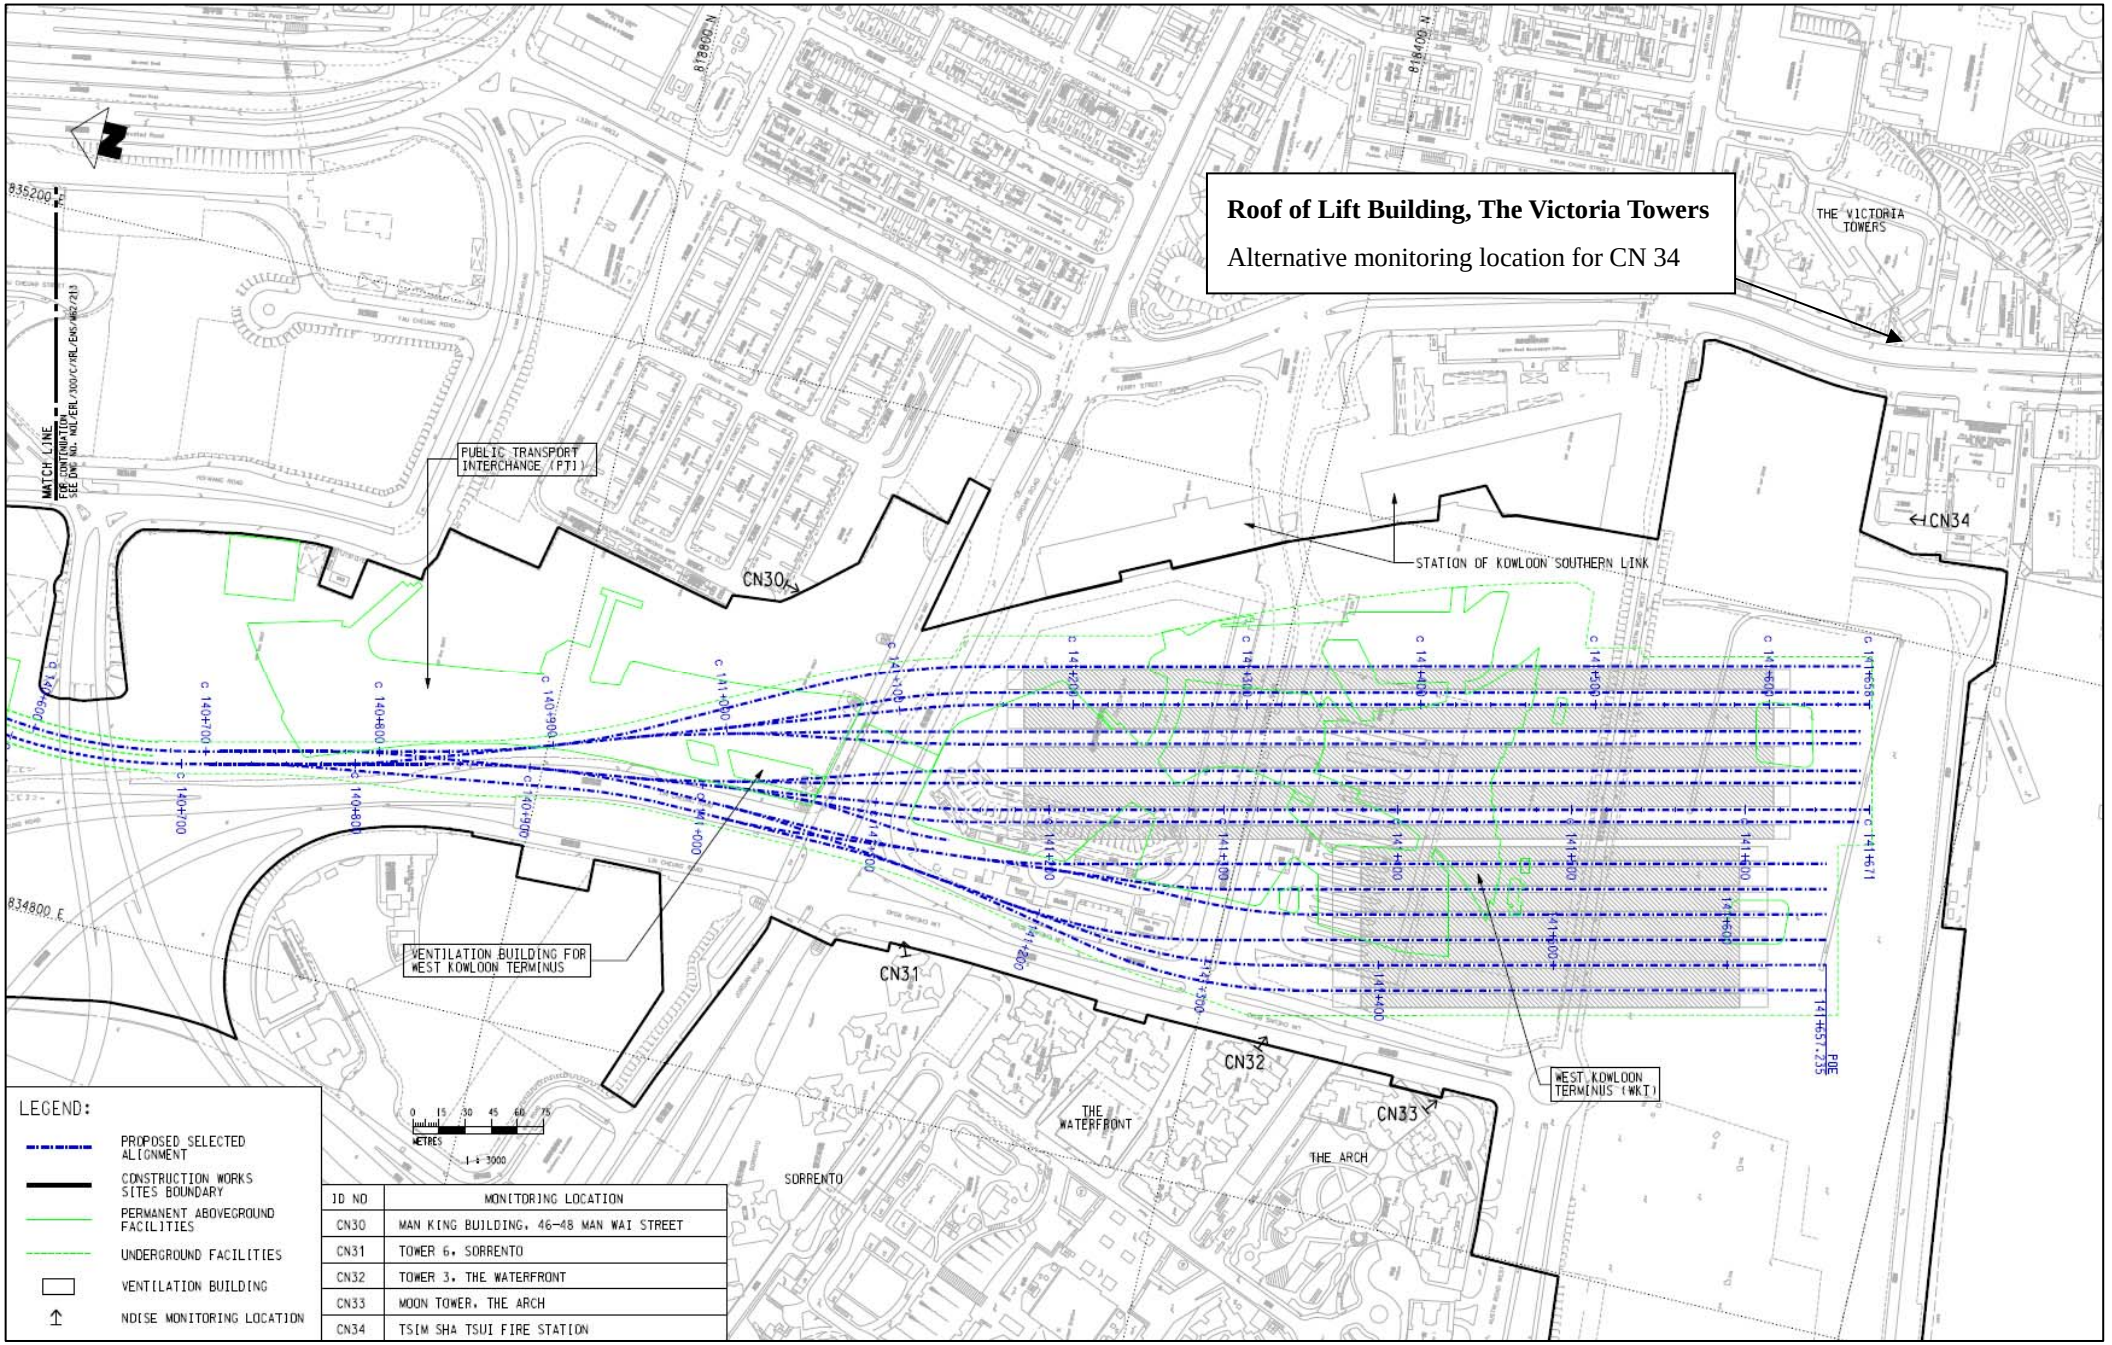

Noise monitoring locations

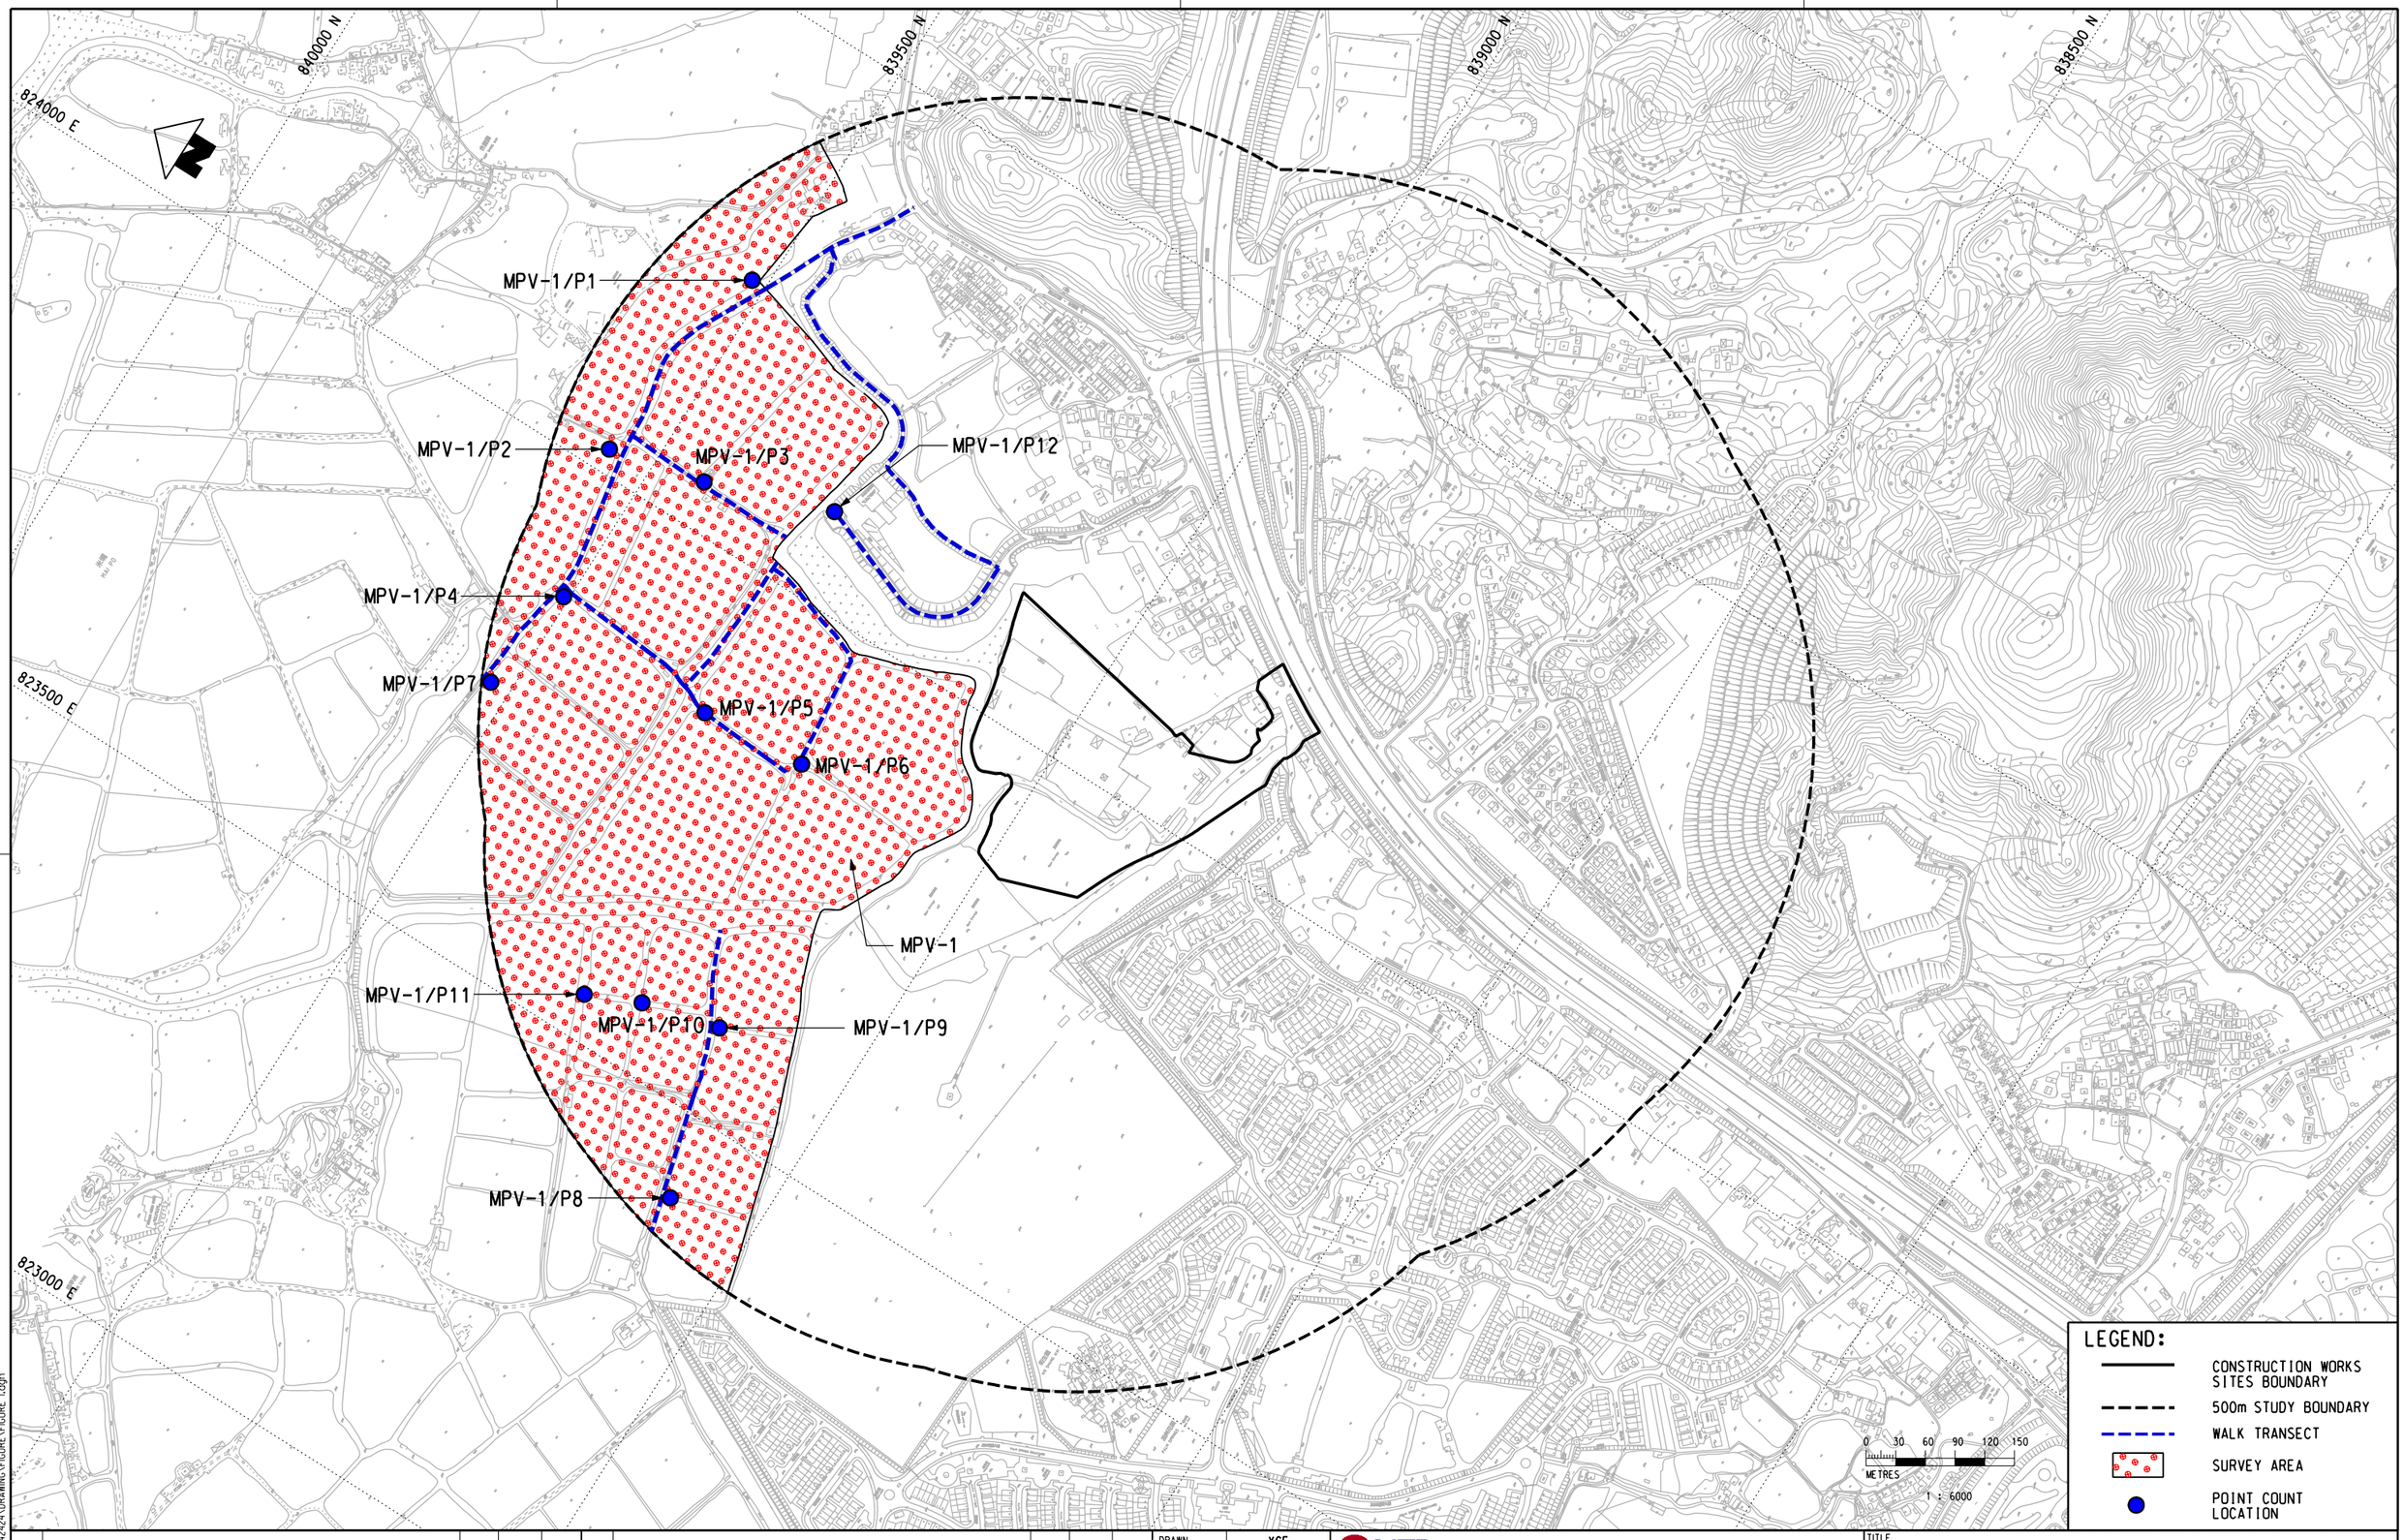

REV	DESCRIPTION	BY	DATE	APPROVED

REV	DESCRIPTION	BY	DATE	APPROVED

DRAWN	XCF
DESIGNED	TWF
CHECKED	KCC
APPROVED	PL
DATE	10/OCT./2008

DO NOT SCALE DRAWINGS. ALL DIMENSIONS SHALL BE VERIFIED ON SITE.
© MTR CORPORATION LIMITED 2008 COPYRIGHT IN RESPECT OF THIS DRAWING / DOCUMENT IS OWNED BY THE MTR CORPORATION LIMITED OF HONG KONG. NO REPRODUCTION OF THE DRAWING / DOCUMENT OR ANY PART BY WHATEVER MEANS IS PERMITTED WITHOUT THE PRIOR WRITTEN CONSENT OF THE MTR CORPORATION LIMITED.

MTR

EXPRESS RAIL LINK

ORIGINATOR

AECOM

CADD REF.
FIGURE 1.dgn

TITLE
NOL / ERL-300
BASELINE BIRD SURVEY FOR EIA
PROPOSED SURVEY AREA, POINT COUNT LOCATION AND WALK TRANSECT FOR MPV-1

SCALE	FIGURE NO.	REV.
1 : 6000 (A3)	FIGURE 1	–

PLOT DRV: r:\ustrnset\MTR\PLOTDRVER\WINDOWS\A3 COLOUR.pH
MODELNAME: Default PRINTED BY: CHENYG 2010-2-5
FILENAME: p:\PROJECTS\60042424\DRAWINGS\FIGURE 1.dgn 859947

834500 N
834000 N
833500 N
824000 E
824500 E
825000 E
825500 E

43CD-1
TPP-3/P3
TPP-3/P1
TPP-3/P2
TPP-3
TPP-2/P4
95CD
TPP-2/P3
TPP-2
TPP-2/P2
TPP-2/P1

0 30 60 90 120 150
METRES
1 : 6000

LEGEND:
- CONSTRUCTION WORKS SITES BOUNDARY
- 500m STUDY BOUNDARY
- WALK TRANSECT
- SURVEY AREA
- POINT COUNT LOCATION

PLOT DRV
MODELNAME:
FILENAME: F:\lastmod\WATER\PLOTDRV\ERWINDOWS\AS COLOUR.plt
DEFAULT
DATA\PROJECTS\60412470\DRAWING\FIGURE\FIGURE 2.dgn
PRINTED BY: spmyg
2009-11 13:51:44

REV	DESCRIPTION	BY	DATE	APPROVED	REV	DESCRIPTION	BY	DATE	APPROVED


DRAWN	YJP
DESIGNED	TWF
CHECKED	KCC
APPROVED	PL
DATE	14/SEP./2009

DO NOT SCALE DRAWINGS. ALL DIMENSIONS SHALL BE VERIFIED ON SITE.
© MTR CORPORATION (LOTS) 2008 COPYRIGHT IN RESPECT OF THIS DRAWING / DOCUMENT IS OWNED BY THE MTR CORPORATION LIMITED OF HONG KONG. NO REPRODUCTION OF THE DRAWING / DOCUMENT OR ANY PART BY WHATEVER MEANS IS PERMITTED WITHOUT THE PRIOR WRITTEN CONSENT OF THE MTR CORPORATION LIMITED.

MTR
EXPRESS RAIL LINK
ORIGINATOR
AECOM
CADD REF. FIGURE 2.dgn

TITLE
NOL / ERL-300
BASELINE BIRD SURVEY FOR EIA
PROPOSED SURVEY AREA, POINT COUNT LOCATION AND WALK TRANSECT FOR TPP-2 AND TPP-3

SCALE	FIGURE NO.	REV
1 : 6000 (A3)	FIGURE 2	-

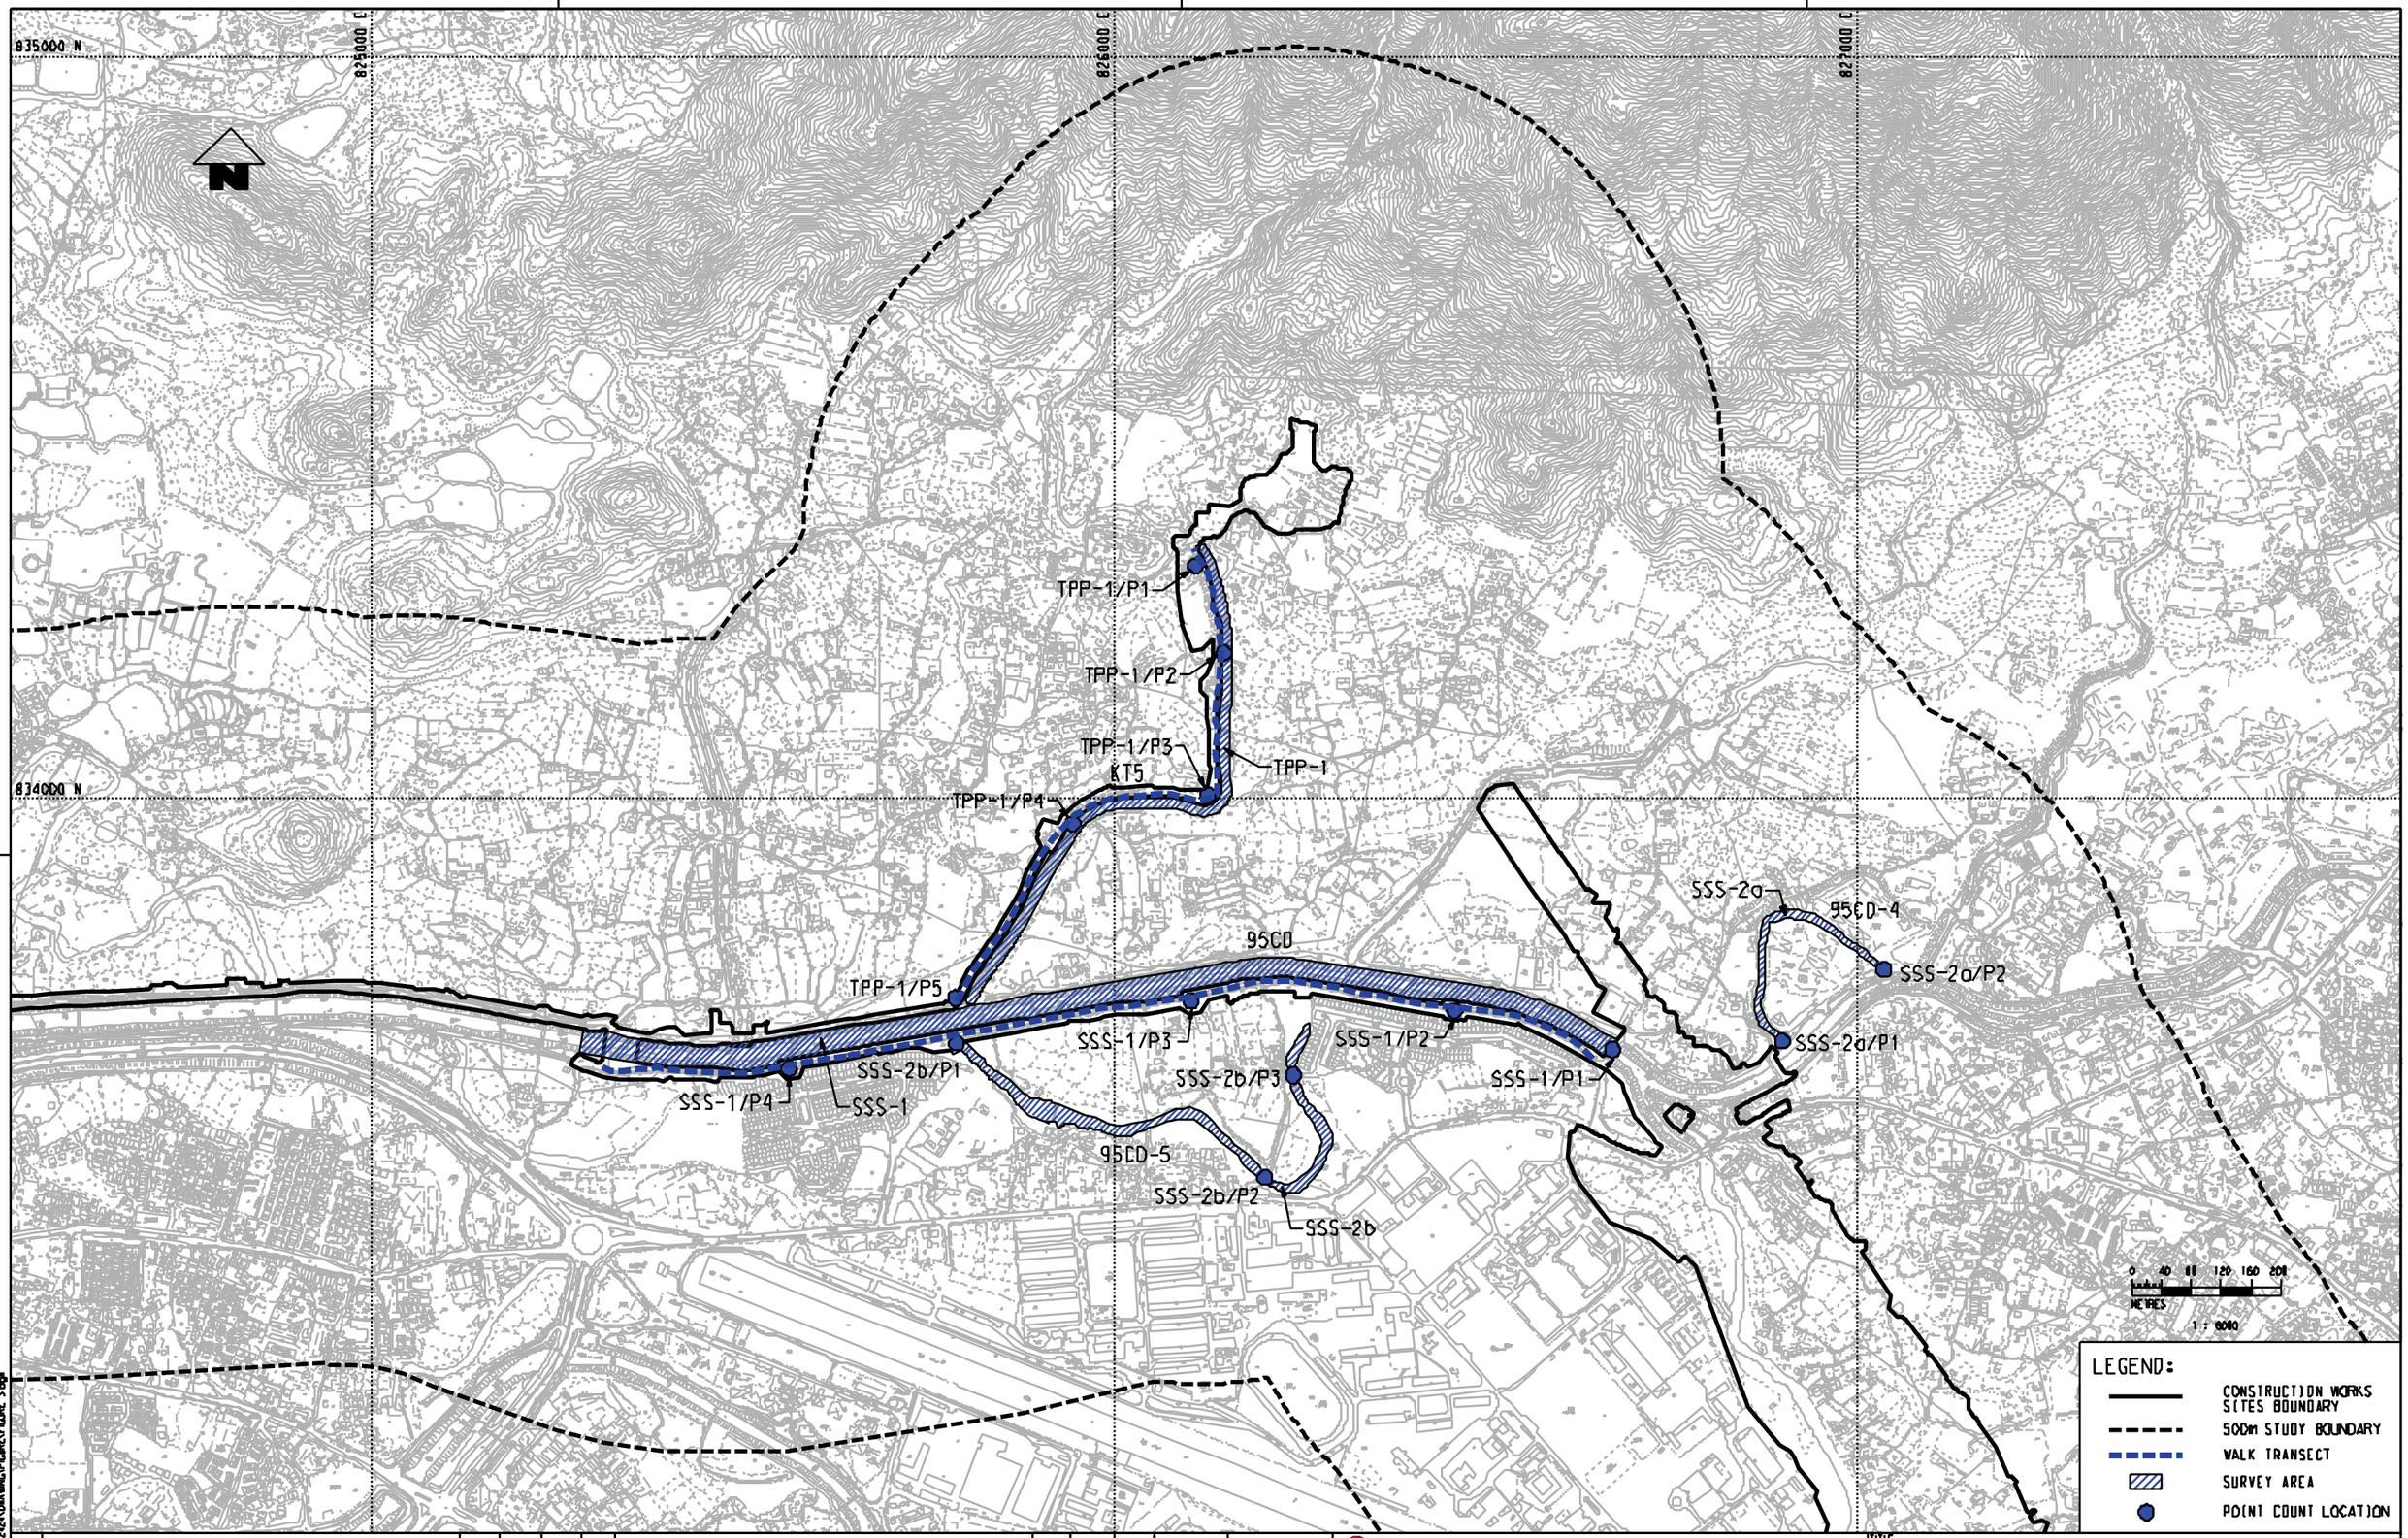

REV	DESCRIPTION	BY	DATE	APPROVED
REV	DESCRIPTION	BY	DATE	APPROVED

DRAWN	Y.JP
DESIGNED	TWF
CHECKED	K.CC
APPROVED	PL
DATE	14/SEP./2009

DO NOT SCALE DRAWINGS. ALL DIMENSIONS SHALL BE VERIFIED ON SITE.
© MTR CORPORATION LIMITED 2008 COPYRIGHT IN RESPECT OF THIS DRAWING / DOCUMENT IS OWNED BY MTR CORPORATION LIMITED OF HONG KONG. NO REPRODUCTION OF THE DRAWING / DOCUMENT OR ANY PART OF IT MAY BE MADE UNLESS PERMITTED BY LAW OR WITH THE PRIOR WRITTEN CONSENT OF MTR CORPORATION LIMITED.

MTR

EXPRESS RAIL LINK

ENDORSEMENT

AECOM

CADD REF FIGURE 3.dgn

TITLE

NOL / ERL-300

BASELINE BIRD SURVEY FOR EIA

PROPOSED SURVEY AREA, POINT COUNT LOCATION AND WALK TRANSECT FOR TPP-1, SSS-1,SSS-2a AND SSS-2b

SCALE 1 : 8000 (A3)

FIGURE NO. FIGURE 3

REV. -

PLOT DRW: c:\autocad\MTRYLO\DRIVER\NODEFLAS COLOUR.ctb
ADDED/MODIFIED BY: Cheryl
PLOTTED BY: 204-rm
FILENAME: P:\PROJECTS\60422\DIAGRAMS\FIGURE 3.dgn
19:13:40

827500 E
828000 E
828500 E
827000 E
833500 N
833000 N
832500 N
832000 N
831500 N

SSS-3

SSS-3/P1
SSS-3/P2
SSS-3/P3
SSS-3/P4
SSS-3/P5
SSS-3/P6
SSS-3/P7
SSS-3/P8
SSS-3/P9
SSS-3/P10
SSS-3/P11
SSS-3/P12

LEGEND:

- CONSTRUCTION WORKS SITES BOUNDARY
- 500m STUDY BOUNDARY
- WALK TRANSECT
- POINT COUNT LOCATION
- ACTIVE AGRICULTURE
- INACTIVE AGRICULTURE
- ACTIVE FISHPOND
- INACTIVE FISHPOND/POND
- REEDBED/FRESHWATER MARSH
- WATERCOURSE
- DRAINAGE CHANNEL
- GRASSLAND
- SEASONALLY WET GRASSLAND
- SECONDARY WOODLAND
- SHRUBLAND
- PLANTATION
- DEVELOPED AREA/WASTEGROUND

0 30 60 90 120 150
METRES
1 : 6000

PLOT DRV
MODELNAME
FILENAME: P:\mastmain\MTRPLOTDRIVER\WINDOWS\AS COLOUR.pltPLOTTED BY: CHWIYP 14/8/24
Default DATE: 2009-11
DATA\PROJECTS\60412621\PLOT\MRG\FIGURE\FIGURE 4.dgn

REV	DESCRIPTION	BY	DATE	APPROVED

REV	DESCRIPTION	BY	DATE	APPROVED

DRAWN	YJP
DESIGNED	TWF
CHECKED	KCC
APPROVED	PL
DATE	07/DEC./2009

DO NOT SCALE DRAWINGS. ALL DIMENSIONS SHALL BE VERIFIED ON SITE.
© MTR CORPORATION (C.I.)TED) 2006 COPYRIGHT IN RESPECT OF THIS DRAWING / DOCUMENT IS OWNED BY THE MTR CORPORATION LIMITED OF HONG KONG. NO REPRODUCTION OF THE WHOLE OR ANY PART OF THIS DRAWING / DOCUMENT MAY BE MADE WITHOUT THE PRIOR WRITTEN CONSENT OF THE MTR CORPORATION LIMITED.

MTR

EXPRESS RAIL LINK

ORIGINATOR
AECOM

CADD REF.
FIGURE 4.dgn

TITLE
NOL / ERL-300
BASELINE BIRD SURVEY FOR EIA
PROPOSED SURVEY AREA, POINT COUNT LOCATION AND WALK TRANSECT FOR SSS-3

SCALE	FIGURE NO.	REV
1 : 6000 (A3)	FIGURE 4	-

827500 E
828000 E
828500 E
833500 N
833000 N
832500 N
832000 N
831500 N

TUW-1/P1
TUW-1/P2
TUW-1/P3
TUW-1/P4
TUW-1/P5
TUW-1/P6
TUW-1/P7
TUW-1

LEGEND:

- CONSTRUCTION WORKS SITES BOUNDARY
- 500m STUDY BOUNDARY
- WALK TRANSECT
- POINT COUNT LOCATION
- ACTIVE AGRICULTURE
- INACTIVE AGRICULTURE
- ACTIVE FISHPOND
- INACTIVE FISHPOND/POND
- REEDBED/FRESHWATER MARSH
- WATERCOURSE
- DRAINAGE CHANNEL
- GRASSLAND
- SEASONALLY WET GRASSLAND
- SECONDARY WOODLAND
- SHRUBLAND
- PLANTATION
- DEVELOPED AREA/WASTEGROUND

0 30 60 90 120 150
METRES
1 : 6000

PLOT DRV: P:\ustmaan\MTRPLOTDRIVER\WIN00RSV.AS COLOUR.pltr
MODELNAME: Default
PLTCHANGE: DATA\PROJECTS\60412621\PLOT\MXD\FIGURE 5.MXD
PLOTTED BY: CHWIYU 2009-11 14:54:44

REV	DESCRIPTION	BY	DATE	APPROVED	REV	DESCRIPTION	BY	DATE	APPROVED

DRAWN	YJP
DESIGNED	TWF
CHECKED	KCC
APPROVED	PL
DATE	07/DEC./2009

DO NOT SCALE DRAWINGS. ALL DIMENSIONS SHALL BE VERIFIED ON SITE.
© MTR CORPORATION (LISTED) 2006 COPYRIGHT IN RESPECT OF THIS DRAWING IS OWNED BY THE MTR CORPORATION LIMITED OF HONG KONG. NO REPRODUCTION OF THE MARKING / DRAWING OR ANY PART BY WHATEVER MEANS IS PERMITTED WITHOUT THE PRIOR WRITTEN CONSENT OF THE MTR CORPORATION LIMITED.

MTR

EXPRESS RAIL LINK

ORIGINATOR: AECOM

CADD REF.: FIGURE 5.dgn

TITLE
NOL / ERL-300
BASELINE BIRD SURVEY FOR EIA
PROPOSED SURVEY AREA, POINT COUNT LOCATION AND WALK TRANSECT FOR TUW-1

SCALE	FIGURE NO.	REV
1 : 6000 (A3)	FIGURE 5	-

826000 E
827000 E
828000 E
829000 E
832000 N
833000 N
831000 N

TUW-2 and PHV-1/P2

TUW-2 and PHV-1/P1

TUW-2 AND PHV-1

LEGEND:

- CONSTRUCTION WORKS SITES BOUNDARY
- 500m STUDY BOUNDARY
- WALK TRANSECT
- SURVEY AREA
- POINT COUNT LOCATION

0 40 80 120 160 200
METRES
1 : 8000

REV	DESCRIPTION	BY	DATE	APPROVED
REV	DESCRIPTION	BY	DATE	APPROVED

DRAWN	CYG
DESIGNED	TWF
CHECKED	KCC
APPROVED	PL
DATE	07/DEC./2009

ON HCM SCALE DRAWINGS, ALL DIMENSIONS SHALL BE USED AS GIVEN.
© MTR CORPORATION LIMITED 2008 COPYRIGHT IN RESPECT OF THIS DRAWING / DOCUMENT IS OWNED BY MTR CORPORATION LIMITED OF HONG KONG. NO PERSON MAY DO ANY ACT WHICH INFRINGES, OR AUTHORISES OR PERMITS ANY INFRINGEMENT OF, ANY OF THE RIGHTS CONFERRED BY THE COPYRIGHT ORDINANCE IN RESPECT OF THIS DRAWING / DOCUMENT.

MTR

EXPRESS RAIL LINK

ORIGINATOR

AECOM

CADD REF FIGURE 6.dgn

TITLE

NOL / ERL-300

BASELINE BIRD SURVEY FOR EIA


PROPOSED SURVEY AREA, POINT COUNT LOCATION AND WALK TRANSECT FOR TUW-2 AND PHV-1

SCALE 1 : 8000 (A3)

FIGURE NO. FIGURE 6

REV. -

PLOT DWG: r:\submit\MTR\PLOTDRWG\WORDFILE\A3 COLOR.pdf
MODIFIED BY: Derfun
FILENAME: P:\PROJECTS\60042210\DRAWING\FIGURE 6.dgn
PLOTTED BY: TANG
2009-12
H:304

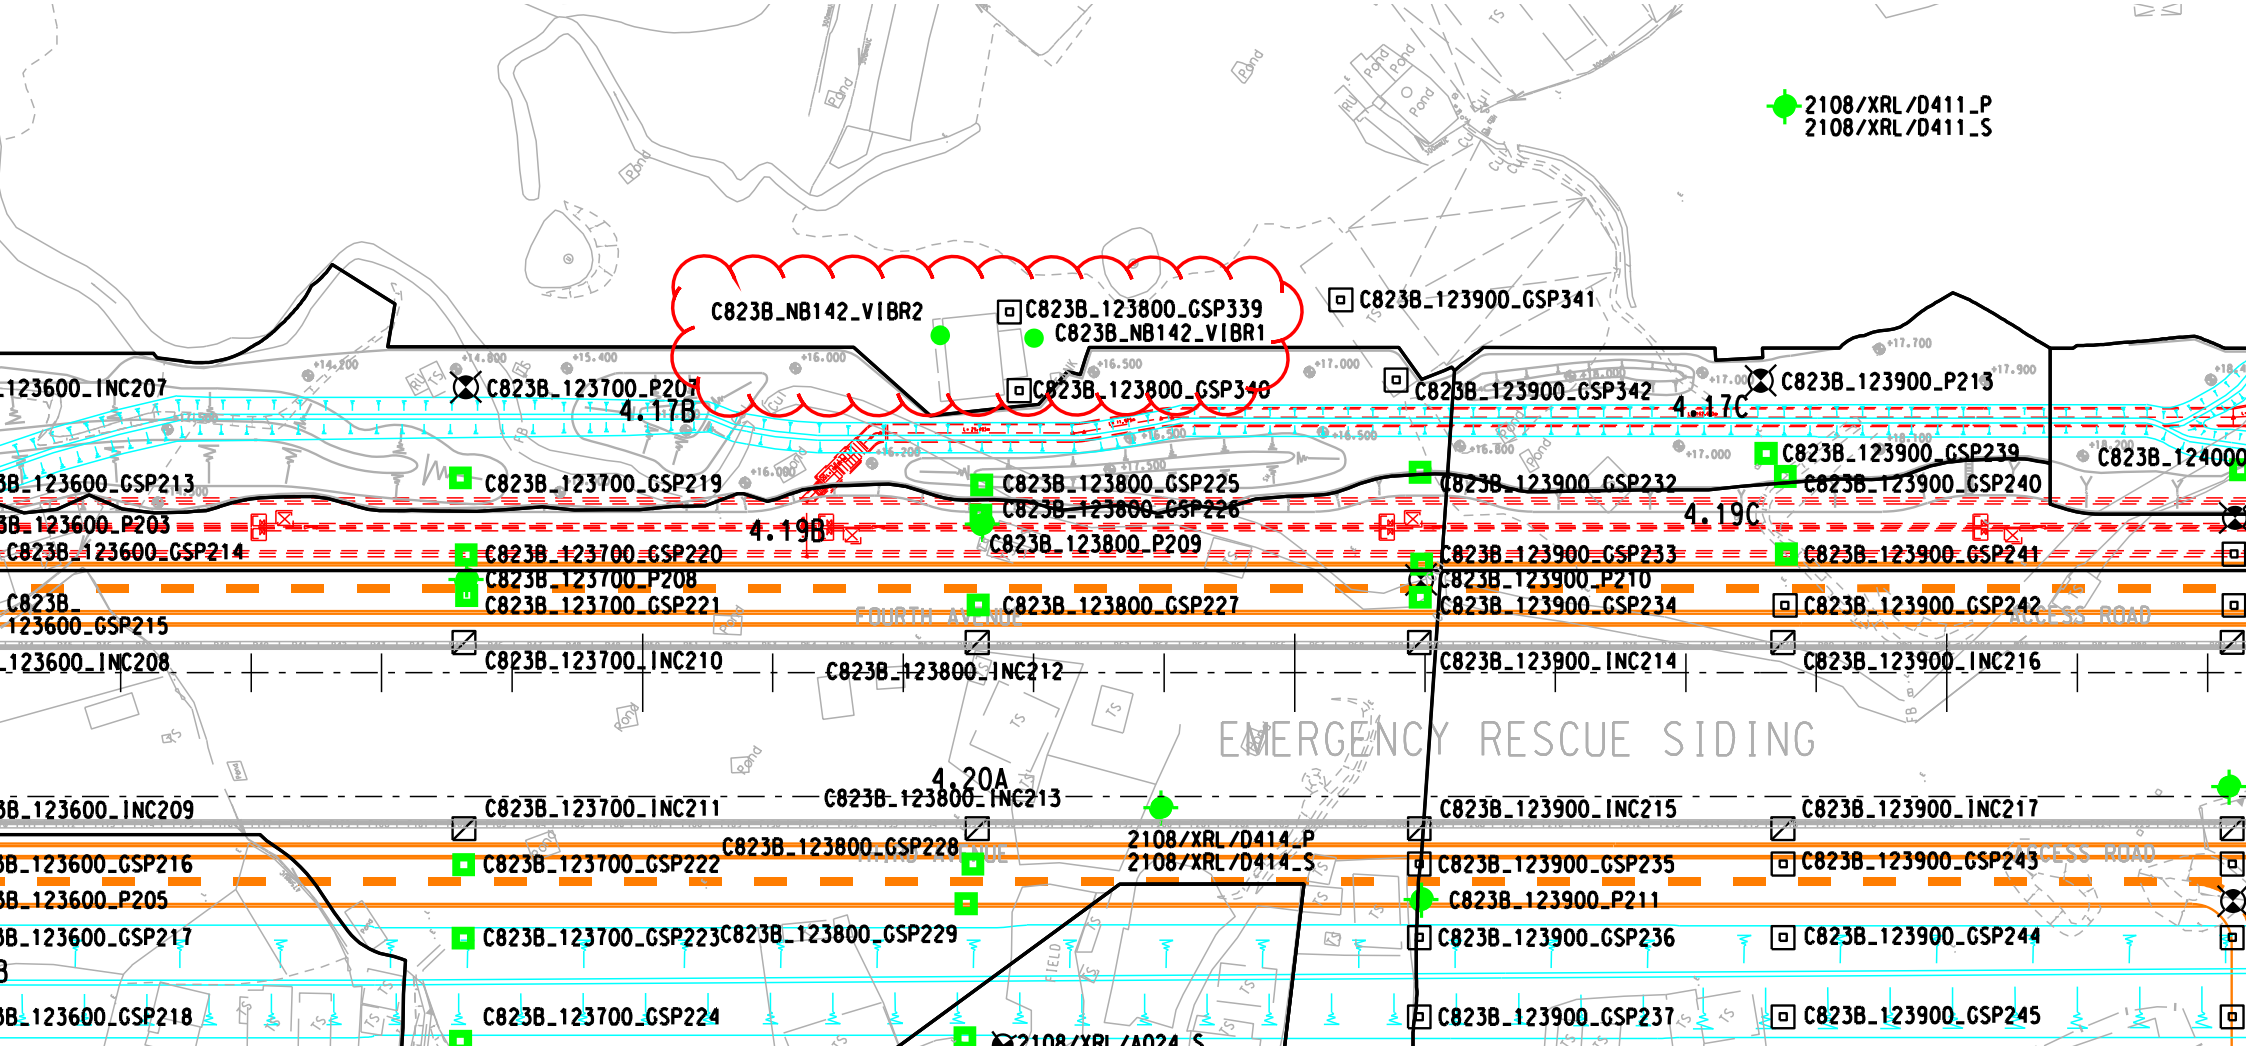
2108/XRL/D411_P
2108/XRL/D411_S
C823B_NB142_VIBR2
C823B_123800_GSP339
C823B_NB142_VIBR1
C823B_123900_GSP341
C823B_123800_GSP340
C823B_123900_GSP342
C823B_123700_P207
4.17B
4.17C
C823B_123900_P213
C823B_123900_GSP239
C823B_124000
C823B_123700_GSP219
C823B_123800_GSP225
C823B_123800_GSP226
C823B_123900_GSP232
C823B_123900_GSP240
4.19B
4.19C
C823B_123800_P209
C823B_123600_GSP214
C823B_123700_GSP220
C823B_123900_GSP233
C823B_123900_GSP241
C823B_123700_P208
C823B_123900_P210
C823B_123700_GSP221
C823B_123800_GSP227
C823B_123900_GSP234
C823B_123900_GSP242
C823B_123600_GSP215
FOURTH AVENUE
ACCESS ROAD
C823B_123700_INC210
C823B_123800_INC212
C823B_123900_INC214
C823B_123900_INC216
EMERGENCY RESCUE SIDING
4.20A
C823B_123800_INC213
C823B_123700_INC211
C823B_123900_INC215
C823B_123900_INC217
C823B_123800_GSP228
2108/XRL/D414_P
2108/XRL/D414_S
C823B_123700_GSP222
C823B_123900_GSP235
C823B_123900_GSP243
C823B_123900_P211
C823B_123700_GSP223
C823B_123800_GSP229
C823B_123900_GSP236
C823B_123900_GSP244
C823B_123700_GSP224
C823B_123900_GSP237
C823B_123900_GSP245

Appendix E

Monitoring Schedule

Actual Construction Dust (24-hr TSP) Impact Monitoring Schedule - July 2011

Note 1: **TSP** denotes Total Suspended Particulate

Jul-2011						
Sunday	**Monday**	**Tuesday**	**Wednesday**	**Thursday**	**Friday**	**Saturday**
					1	2 AM1, AM2, AM4, AM9, AM10
3	4 AM5, AM6, AM7, AM8*	5	6 AM11, AM12, AM13, AM14, AM15, AM16, AM17	7	8 AM1, AM2, AM4, AM9, AM10	9 AM5, AM6, AM7, AM8*
10	11	12 AM11, AM12, AM13, AM14, AM15, AM16, AM17	13	14 AM1, AM2, AM4, AM9, AM10	15 AM5, AM6, AM7, AM8*	16
17	18 AM11, AM12, AM13, AM14, AM15, AM16, AM17	19	20 AM1, AM2, AM4, AM9, AM10	21 AM5, AM6, AM7, AM8*	22	23 AM11, AM12, AM13, AM14, AM15, AM16, AM17
24	25	26 AM1, AM2, AM4, AM9, AM10	27 AM3, AM5, AM6, AM7, AM8*	28	29 AM11, AM12, AM13, AM14, AM15, AM16, AM17	30
31						

* 24-hr TSP impact monitoring for AM3 were suspected on 4 July 2011, 9 July 2011, 15 July 2011 and 21 July 2011 due to termination of power supply on site

Tentative Construction Dust (24-hr TSP) Impact Monitoring Schedule - August 2011

Note 1: **TSP** denotes Total Suspended Particulate

Aug-2011						
Sunday	**Monday**	**Tuesday**	**Wednesday**	**Thursday**	**Friday**	**Saturday**
	1 AM1, AM2, AM4, AM9, AM10	2 AM3, AM5, AM6, AM7, AM8	3	4 AM11, AM12, AM13, AM14, AM15, AM16, AM17	5	6 AM1, AM2, AM4, AM9, AM10
7	8 AM3, AM5, AM6, AM7, AM8	9	10 AM11, AM12, AM13, AM14, AM15, AM16, AM17	11	12 AM1, AM2, AM4, AM9, AM10	13 AM3, AM5, AM6, AM7, AM8
14	15	16 AM11, AM12, AM13, AM14, AM15, AM16, AM17	17	18 AM1, AM2, AM4, AM9, AM10	19 AM3, AM5, AM6, AM7, AM8	20
21	22 AM11, AM12, AM13, AM14, AM15, AM16, AM17	23	24 AM1, AM2, AM4, AM9, AM10	25 AM3, AM5, AM6, AM7, AM8	26	27 AM11, AM12, AM13, AM14, AM15, AM16, AM17
28	29	30 AM1, AM2, AM4, AM9, AM10	31 AM3, AM5, AM6, AM7, AM8			

Monitoring Schedule in the Reporting Month (01 Jul 2011 - 31 Jul 2011)

	CN1	CN2	CN3	CN4	CN5	CN6	CN7	CN8	CN9	CN10	CN11	CN12	CN13	CN14	CN15	CN16
Date	No. 142 Mai Po San Tsuen	Mai Po San Tsuen Village Hse	Yau Tam Mei Village House	Yau Tam Mei Village House	Kong Tai Road Village House	Kong Tai Road Village House	House 93, Seasons Villas	DD110 LOT 482, Wang Toi Shan	Leung Uk Tsuen Village House	Leung Uk Tsuen Squats	182B, Wang Toi Shan San Tsuen	630 Sheung Tsuen	No. 489H Tse Uk Tsuen	Tse Uk Tsuen	No. 305B - Sheung Tsuen San Tsuen Village	DD 114 LOT 1405 Sheung Tsuen
01-Jul-11																
02-Jul-11																
03-Jul-11																
04-Jul-11															√	
05-Jul-11	√	√	√		√	√	√	√	√	√	√	√	√	√		
06-Jul-11				√												√
07-Jul-11																
08-Jul-11																
09-Jul-11																
10-Jul-11																
11-Jul-11																
12-Jul-11																
13-Jul-11			√													
14-Jul-11	√	√		√	√	√	√	√	√	√	√		√	√	√	√
15-Jul-11												√				
16-Jul-11																
17-Jul-11																
18-Jul-11															√	√
19-Jul-11	√	√	√		√	√		√	√	√	√	√	√	√		
20-Jul-11																
21-Jul-11				√			√									
22-Jul-11																
23-Jul-11																
24-Jul-11																
25-Jul-11															√	√
26-Jul-11		√	√		√		√	√	√	√	√		√	√		
27-Jul-11	√															
28-Jul-11				√		√						√				
29-Jul-11																
30-Jul-11																
31-Jul-11																

Monitoring Schedule in the Reporting Month (01 Jul 2011 - 31 Jul 2011)

	CN18	CN19	CN20	CN21	CN22	CN23	CN24	CN25	CN26	CN27	CN28	CN29	CN30	CN31	CN32	CN33	CN34
Date	Sau Shan House	Sun Fung Centre	VTC Kwai Chung	Po Leung Kuk Tong Nai Kan College	Block I, Lai Chi Kok Reception Centre	HKIVE Haking Wong Waterfront Annex	St. Andrew Primary School	St. Mary's Church Mok Hing Yiu College	Ying Wah College	Cheong Shun House, Nam Cheong Estate	Tower 6, Harbour Green	Yaumati Catholic Primary School	Man Cheong Street Refuse Collection Point	Tower 6, Sorrento	Tower 3, The Waterfront	Star Tower, The Arch	The Victoria Towers
01-Jul-11																	
02-Jul-11																	
03-Jul-11																	
04-Jul-11	√	√															
05-Jul-11			√	√	√		√	√		√		√	√				
06-Jul-11						√			√						√	√	√
07-Jul-11																	
08-Jul-11											√			√			
09-Jul-11																	
10-Jul-11																	
11-Jul-11																	
12-Jul-11																	
13-Jul-11																	
14-Jul-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
15-Jul-11																	
16-Jul-11																	
17-Jul-11																	
18-Jul-11	√	√															
19-Jul-11			√											√		√	
20-Jul-11						√											
21-Jul-11				√	√		√	√	√	√	√	√	√		√		√
22-Jul-11																	
23-Jul-11																	
24-Jul-11																	
25-Jul-11	√	√						√									
26-Jul-11			√											√		√	√
27-Jul-11						√			√		√						
28-Jul-11				√	√		√			√		√	√		√		
29-Jul-11																	
30-Jul-11																	
31-Jul-11																	

Monitoring Schedule in the Next Reporting Month (01 Aug 2011 - 31 Aug 2011)

	CN1	CN2	CN3	CN4	CN5	CN6	CN7	CN8	CN9	CN10	CN11	CN12	CN13	CN14	CN15	CN16
Date	No. 142 Mai Po San Tsuen	Mai Po San Tsuen Village Hse	Yau Tam Mei Village House	Yau Tam Mei Village House	Kong Tai Road Village House	Kong Tai Road Village House	House 93, Seasons Villas	DD110 LOT 482, Wang Toi Shan	Leung Uk Tsuen Village House	Leung Uk Tsuen Squats	182B, Wang Toi Shan San Tsuen	630 Sheung Tsuen	No. 489H Tse Uk Tsuen	Tse Uk Tsuen	No. 305B - Sheung Tsuen San Tsuen Village	DD 114 LOT 1405 Sheung Tsuen
01-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
02-Aug-11																
03-Aug-11																
04-Aug-11																
05-Aug-11																
06-Aug-11																
07-Aug-11																
08-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
09-Aug-11																
10-Aug-11																
11-Aug-11																
12-Aug-11																
13-Aug-11																
14-Aug-11																
15-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
16-Aug-11																
17-Aug-11																
18-Aug-11																
19-Aug-11																
20-Aug-11																
21-Aug-11																
22-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
23-Aug-11																
24-Aug-11																
25-Aug-11																
26-Aug-11																
27-Aug-11																
28-Aug-11																
29-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
30-Aug-11																
31-Aug-11																

Monitoring Schedule in the Next Reporting Month (01 Aug 2011 - 31 Aug 2011)

	CN18	CN19	CN20	CN21	CN22	CN23	CN24	CN25	CN26	CN27	CN28	CN29	CN30	CN31	CN32	CN33	CN34
Date	Sau Shan House	Sun Fung Centre	VTC Kwai Chung	Po Leung Kuk Tong Nai Kan College	Block I, Lai Chi Kok Reception Centre	HKIVE Haking Wong Waterfront Annex	St. Andrew Primary School	St. Mary's Church Mok Hing Yiu College	Ying Wah College	Cheong Shun House, Nam Cheong Estate	Tower 6, Harbour Green	Yaumati Catholic Primary School	Man Cheong Street Refuse Collection Point	Tower 6, Sorrento	Tower 3, The Waterfront	Star Tower, The Arch	The Victoria Towers
01-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
02-Aug-11																	
03-Aug-11																	
04-Aug-11																	
05-Aug-11																	
06-Aug-11																	
07-Aug-11																	
08-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
09-Aug-11																	
10-Aug-11																	
11-Aug-11																	
12-Aug-11																	
13-Aug-11																	
14-Aug-11																	
15-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
16-Aug-11																	
17-Aug-11																	
18-Aug-11																	
19-Aug-11																	
20-Aug-11																	
21-Aug-11																	
22-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
23-Aug-11																	
24-Aug-11																	
25-Aug-11																	
26-Aug-11																	
27-Aug-11																	
28-Aug-11																	
29-Aug-11	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√	√
30-Aug-11																	
31-Aug-11																	

Appendix E Monitoring Schedule

Works Area	Survey Site	Date of Survey in July 2011	Tentative Date of Survey in August 2011
MPV	MPV-1	July 14, 2011	August 18, 2011
Access road leading to TPP	TPP-1	July 14, 2011	August 18, 2011
Access road leading to TPP	TPP-2	July 14, 2011	August 18, 2011
Access road leading to TPP	TPP-3	July 14, 2011	August 18, 2011
Access road leading to SSS / ERS	SSS-2a	July 14, 2011	August 18, 2011
Access road leading to SSS / ERS	SSS-3	July 14, 2011	August 22, 2011
TUW	TUW-1	July 21, 2011	August 22, 2011
TUW	TUW-2 (grouped with PHV-1 due to overlapping of survey area	July 21, 2011	August 22, 2011
PHV	PHV-1 (grouped with TUW-2 due to overlapping of survey area)	July 21, 2011	August 22, 2011

Appendix F

Graphical Plots of Monitoring Results

APPENDIX F: Air Quality Monitoring Results - 24-hour TSP Monitoring

- AM1

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
02-Jul-11	64.9	217.3	260.0
08-Jul-11	66.9	217.3	260.0
14-Jul-11	58.4	217.3	260.0
20-Jul-11	46.1	217.3	260.0
26-Jul-11	70.0	217.3	260.0

- AM2

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
02-Jul-11	43.2	179.4	260.0
08-Jul-11	43.9	179.4	260.0
14-Jul-11	23.5	179.4	260.0
20-Jul-11	39.7	179.4	260.0
26-Jul-11	38.0	179.4	260.0

- AM3

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
27-Jul-11	16.6	154.7	260.0

- AM4

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
02-Jul-11	38.3	148.6	260.0
08-Jul-11	96.3	148.6	260.0
14-Jul-11	33.8	148.6	260.0
20-Jul-11	43.3	148.6	260.0
26-Jul-11	51.9	148.6	260.0

- AM5

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
04-Jul-11	118.0	152.0	260.0
09-Jul-11	18.7	152.0	260.0
15-Jul-11	35.3	152.0	260.0
21-Jul-11	23.5	152.0	260.0
27-Jul-11	19.8	152.0	260.0

- AM6

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
04-Jul-11	30.5	145.6	260.0
09-Jul-11	15.6	145.6	260.0
15-Jul-11	65.8	145.6	260.0
21-Jul-11	23.6	145.6	260.0
27-Jul-11	27.7	145.6	260.0

- AM7

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
04-Jul-11	39.4	149.8	260.0
09-Jul-11	13.9	149.8	260.0
15-Jul-11	38.9	149.8	260.0
21-Jul-11	36.2	149.8	260.0
27-Jul-11	21.6	149.8	260.0

- AM8

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
04-Jul-11	34.9	158.2	260.0
09-Jul-11	55.4	158.2	260.0
15-Jul-11	63.1	158.2	260.0
21-Jul-11	31.2	158.2	260.0
27-Jul-11	43.7	158.2	260.0

Remark: - Bold value indicated an Action level exceedance
- Bold & Italic value indicated an Limit level exceedance

- 24-hr TSP impact monitoring for AM3 were suspected on 4 July 2011, 9 July 2011, 15 July 2011 and 21 July 2011 due to termination of power supply on site.

APPENDIX F: Air Quality Monitoring Results - 24-hour TSP Monitoring

- AM9

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
02-Jul-11	45.4	171.2	260.0
08-Jul-11	35.5	171.2	260.0
14-Jul-11	63.0	171.2	260.0
20-Jul-11	57.1	171.2	260.0
26-Jul-11	40.8	171.2	260.0

- AM10

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
02-Jul-11	42.6	174.8	260.0
08-Jul-11	42.0	174.8	260.0
14-Jul-11	49.9	174.8	260.0
20-Jul-11	29.7	174.8	260.0
26-Jul-11	45.7	174.8	260.0

- AM11

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	47.4	160.3	260.0
12-Jul-11	33.5	160.3	260.0
18-Jul-11	30.0	160.3	260.0
23-Jul-11	31.1	160.3	260.0
29-Jul-11	41.7	160.3	260.0

- AM12

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	21.8	162.5	260.0
12-Jul-11	38.2	162.5	260.0
18-Jul-11	53.1	162.5	260.0
23-Jul-11	40.3	162.5	260.0
29-Jul-11	45.0	162.5	260.0

- AM13

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	39.6	180.3	260.0
12-Jul-11	33.5	180.3	260.0
18-Jul-11	51.5	180.3	260.0
23-Jul-11	25.4	180.3	260.0
29-Jul-11	32.1	180.3	260.0

- AM14

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	37.7	158.2	260.0
12-Jul-11	35.7	158.2	260.0
18-Jul-11	46.2	158.2	260.0
23-Jul-11	21.3	158.2	260.0
29-Jul-11	41.9	158.2	260.0

- AM15

Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	32.3	168.8	260.0
12-Jul-11	35.2	168.8	260.0
18-Jul-11	30.4	168.8	260.0
23-Jul-11	18.8	168.8	260.0
29-Jul-11	42.5	168.8	260.0


- AM16


Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	40.7	155.9	260.0
12-Jul-11	37.4	155.9	260.0
18-Jul-11	27.7	155.9	260.0
23-Jul-11	19.3	155.9	260.0
29-Jul-11	45.4	155.9	260.0

- AM17


Date	24-hour TSP Monitoring Results	Action Level	Limit Level
	(μg/m^3)	(μg/m^3)	(μg/m^3)
06-Jul-11	30.2	179.3	260.0
12-Jul-11	51.7	179.3	260.0
18-Jul-11	53.7	179.3	260.0
23-Jul-11	21.3	179.3	260.0
29-Jul-11	57.7	179.3	260.0


Remark: Bold value indicated an Action level exceedance
Bold & Italic value indicated an Limit level exceedance

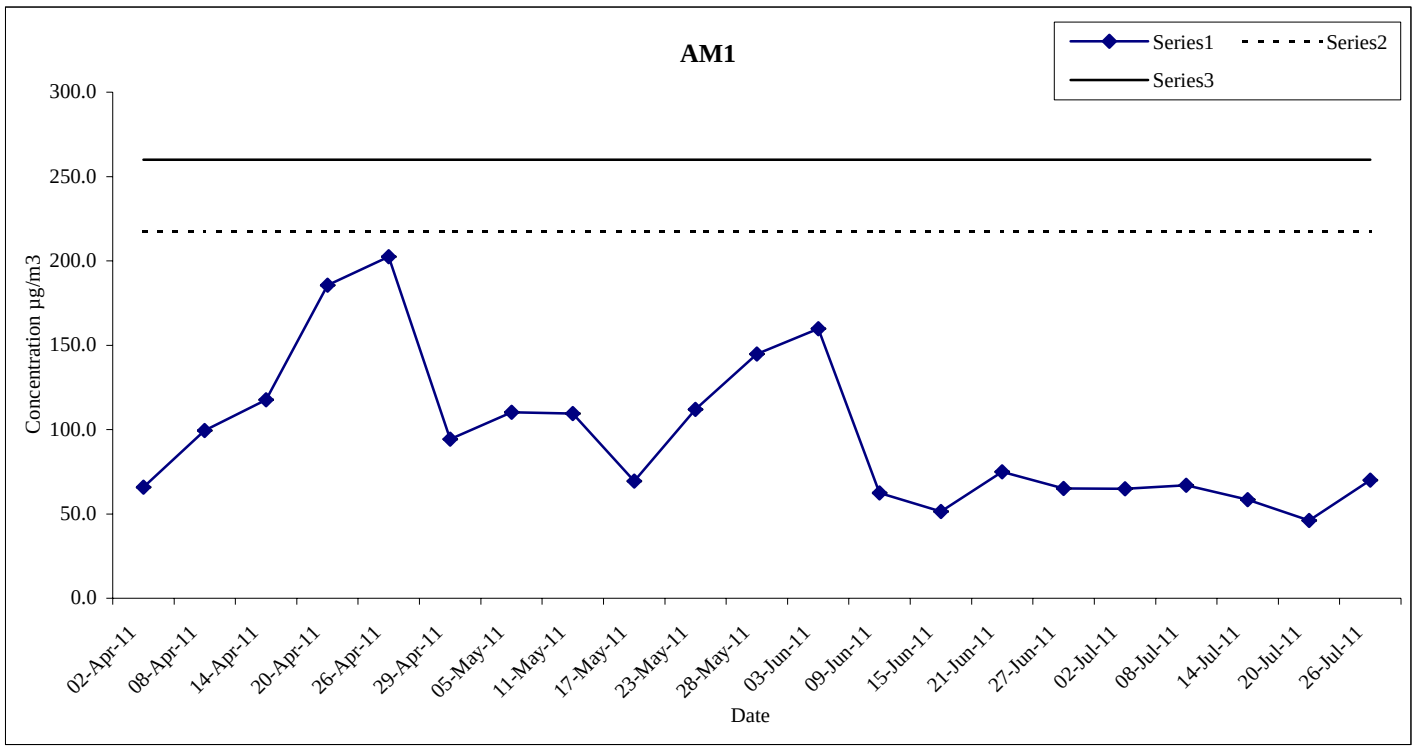

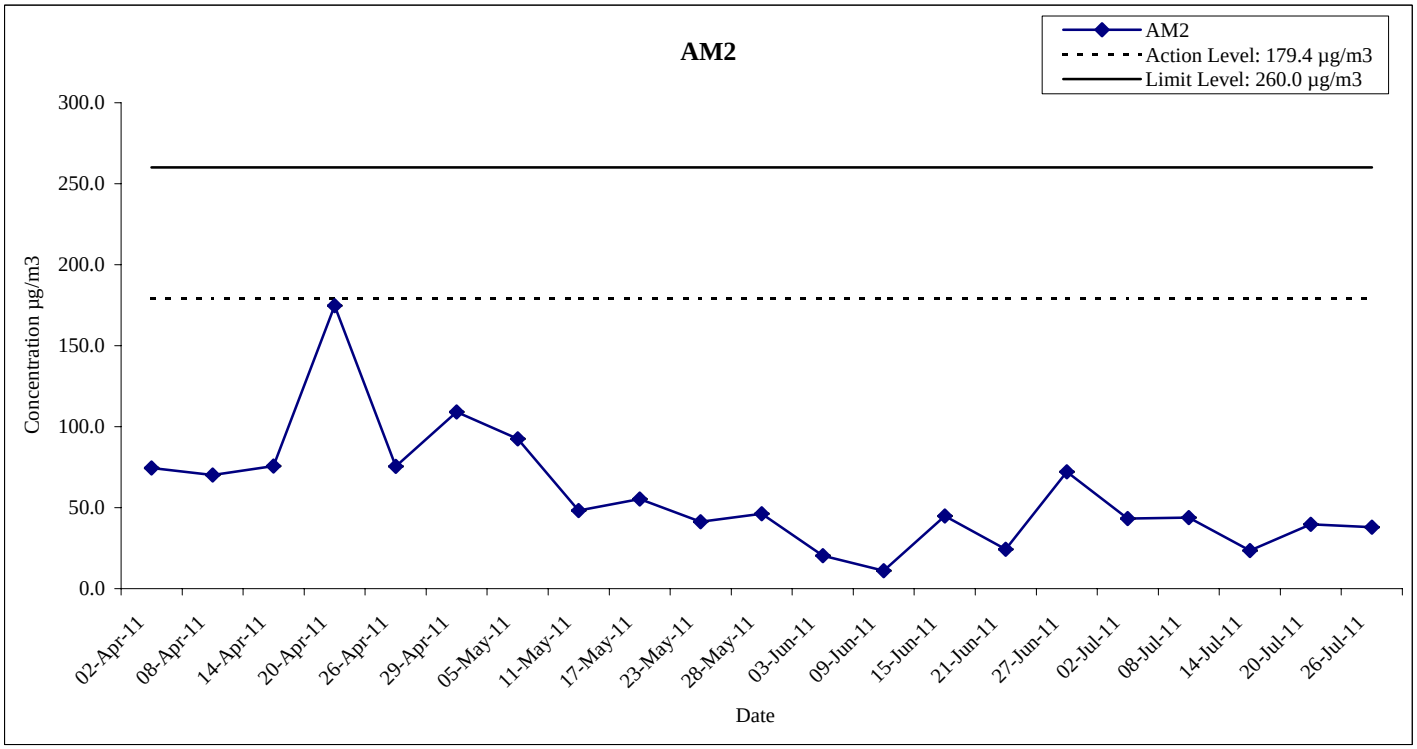


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM1 and AM2**	**Date**	**2011**
		APPENDIX	**F**

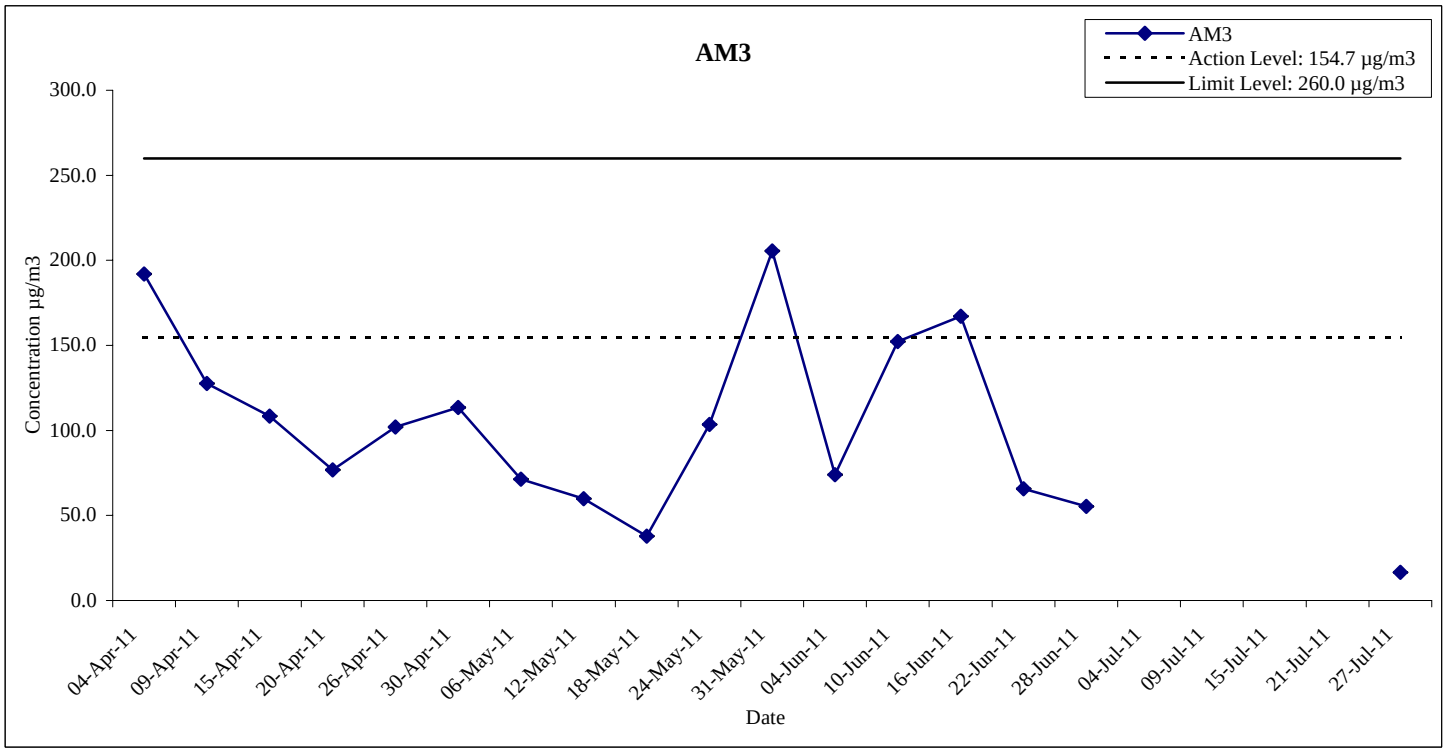


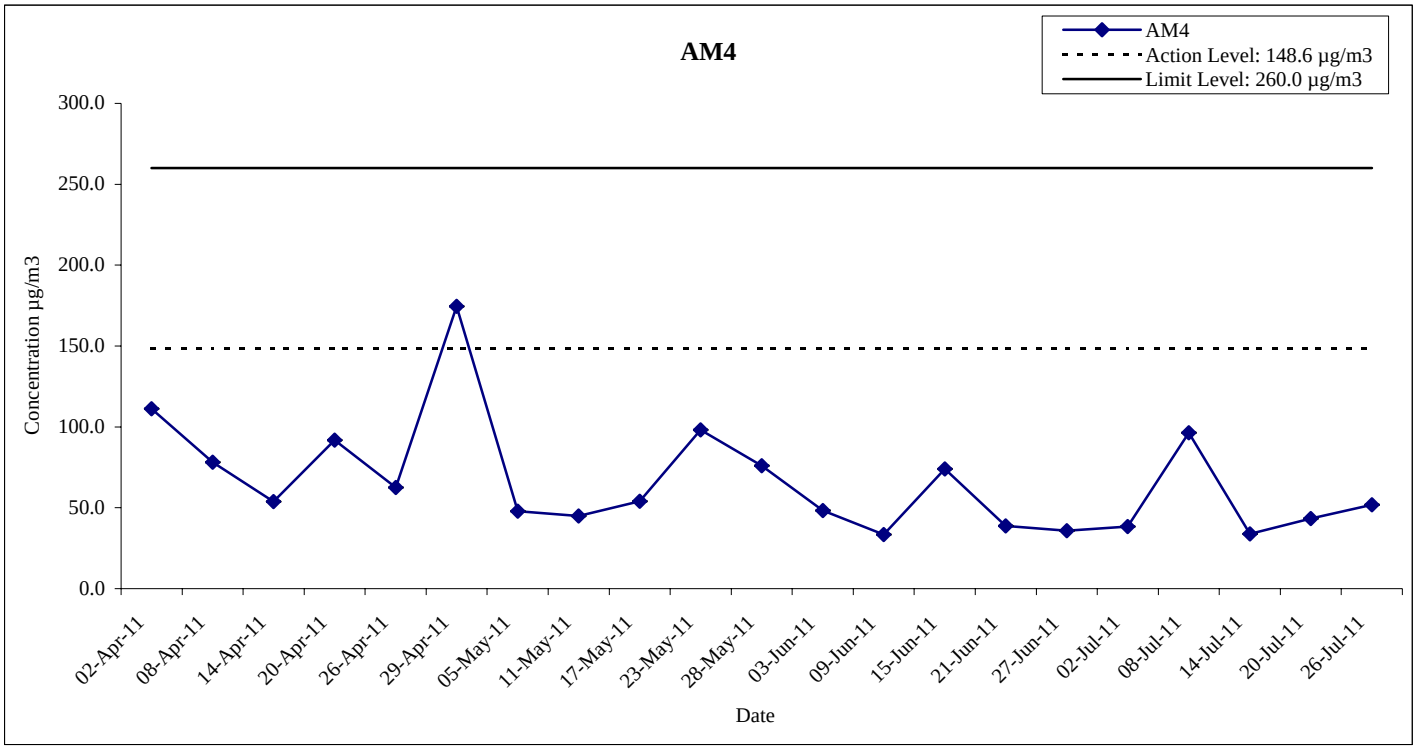


Remarks:
- 24-hr TSP impact monitoring for AM3 were suspected on 4 July 2011, 9 July 2011, 15 July 2011 and 21 July 2011 due to termination of power supply on site.


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM3 and AM4**	**Date**	**2011**
		APPENDIX	**F**

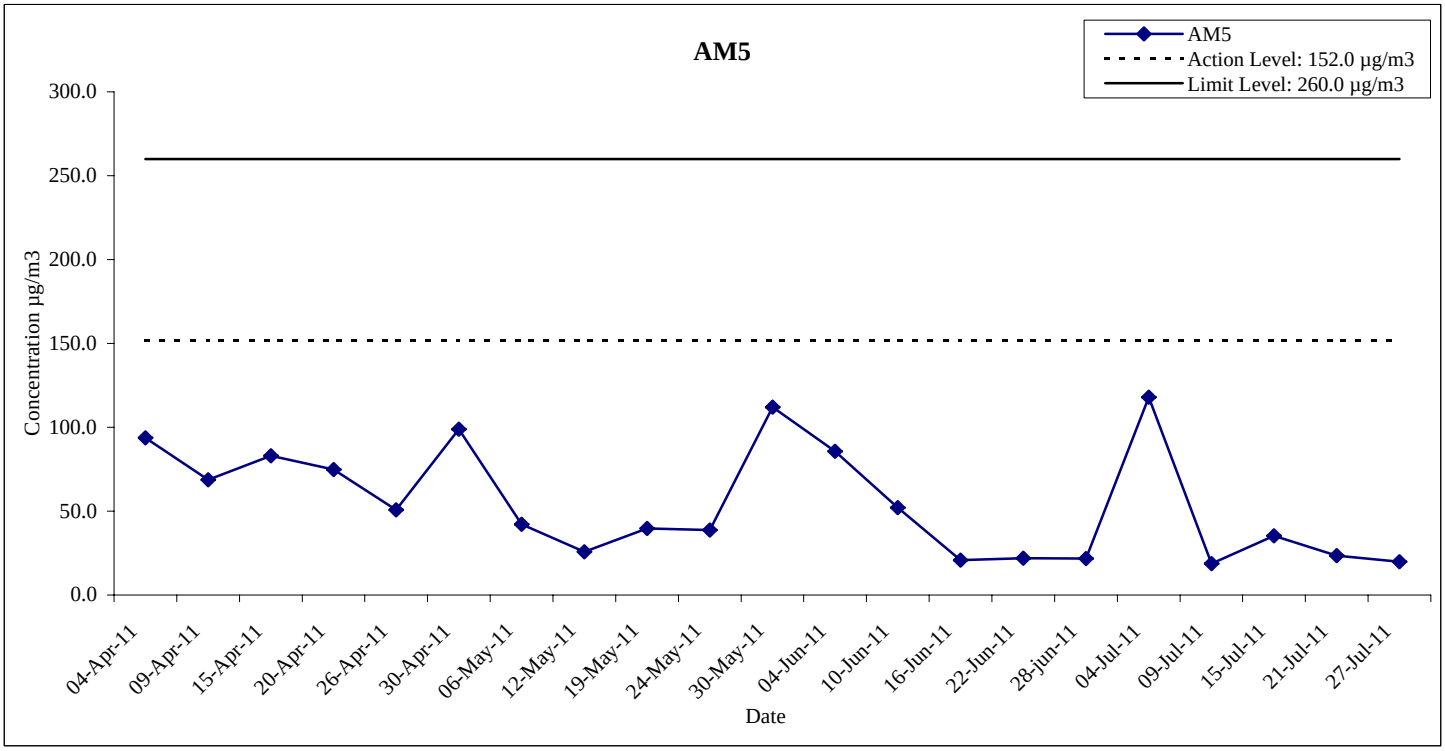

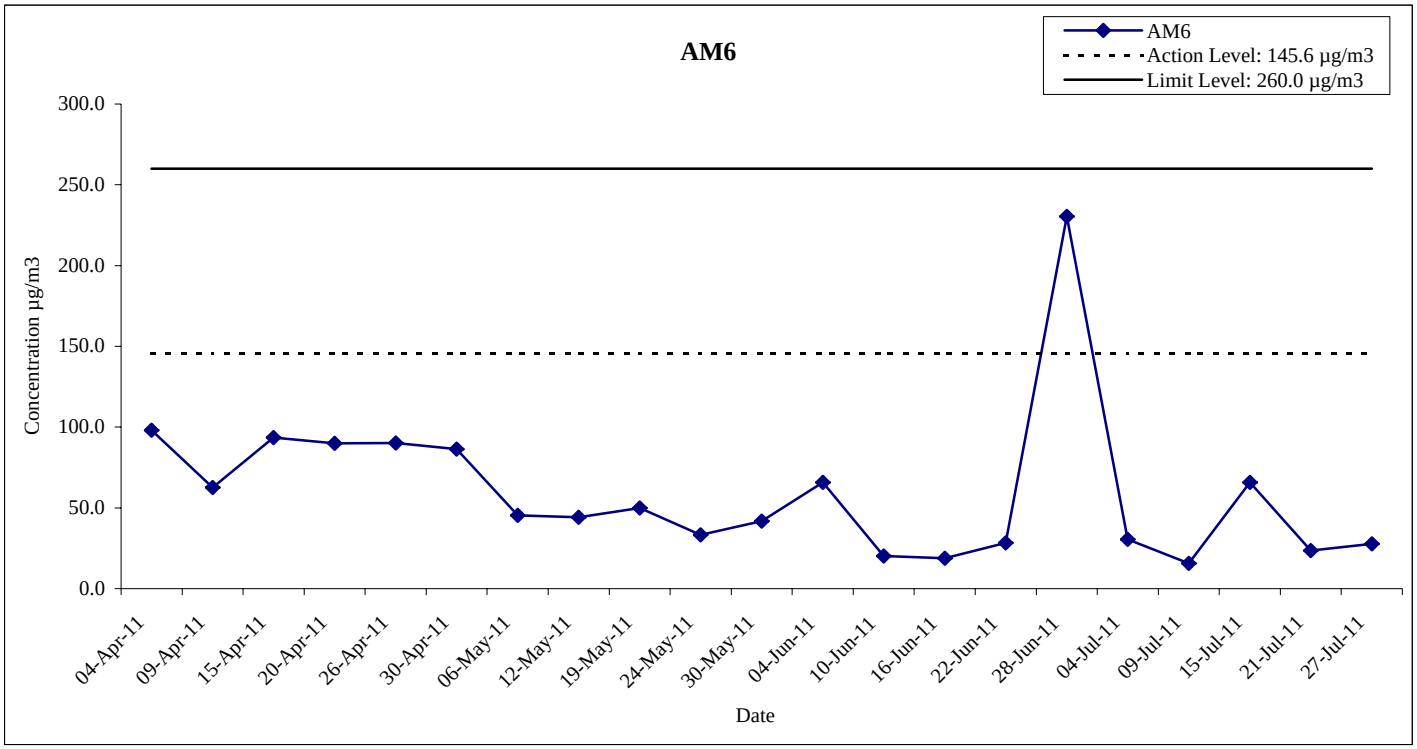



MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM5 and AM6**	**Date**	**2011**
		APPENDIX	**F**

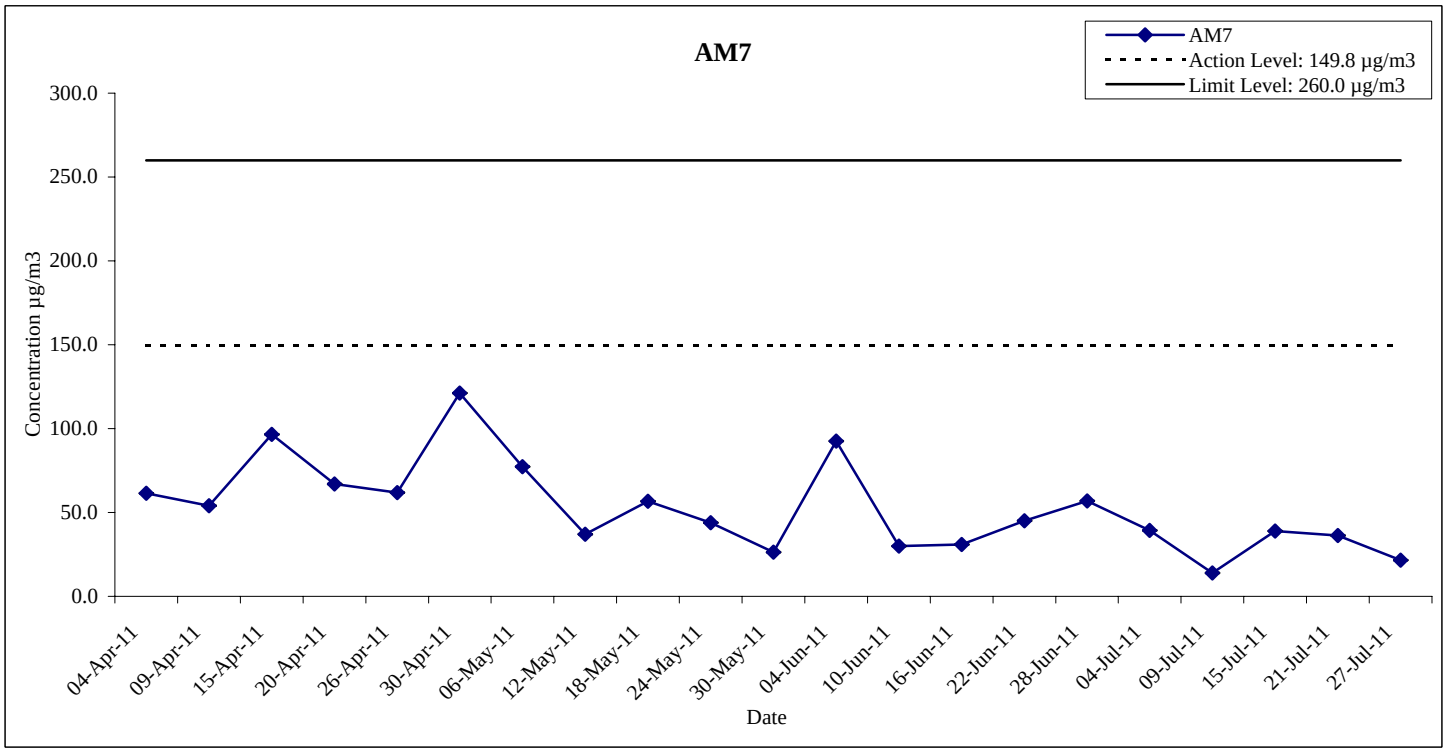

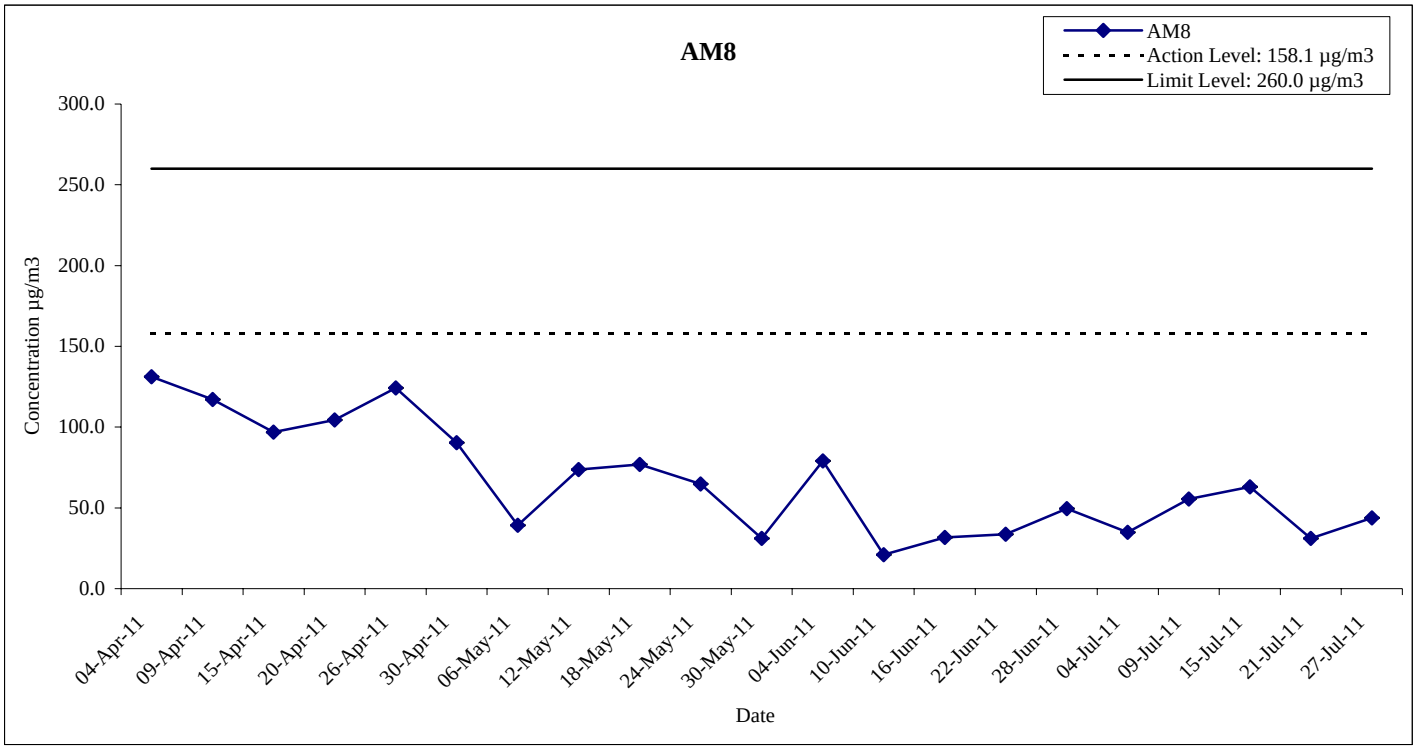



MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM7 and AM8**	**Date**	**2011**
		APPENDIX	**F**

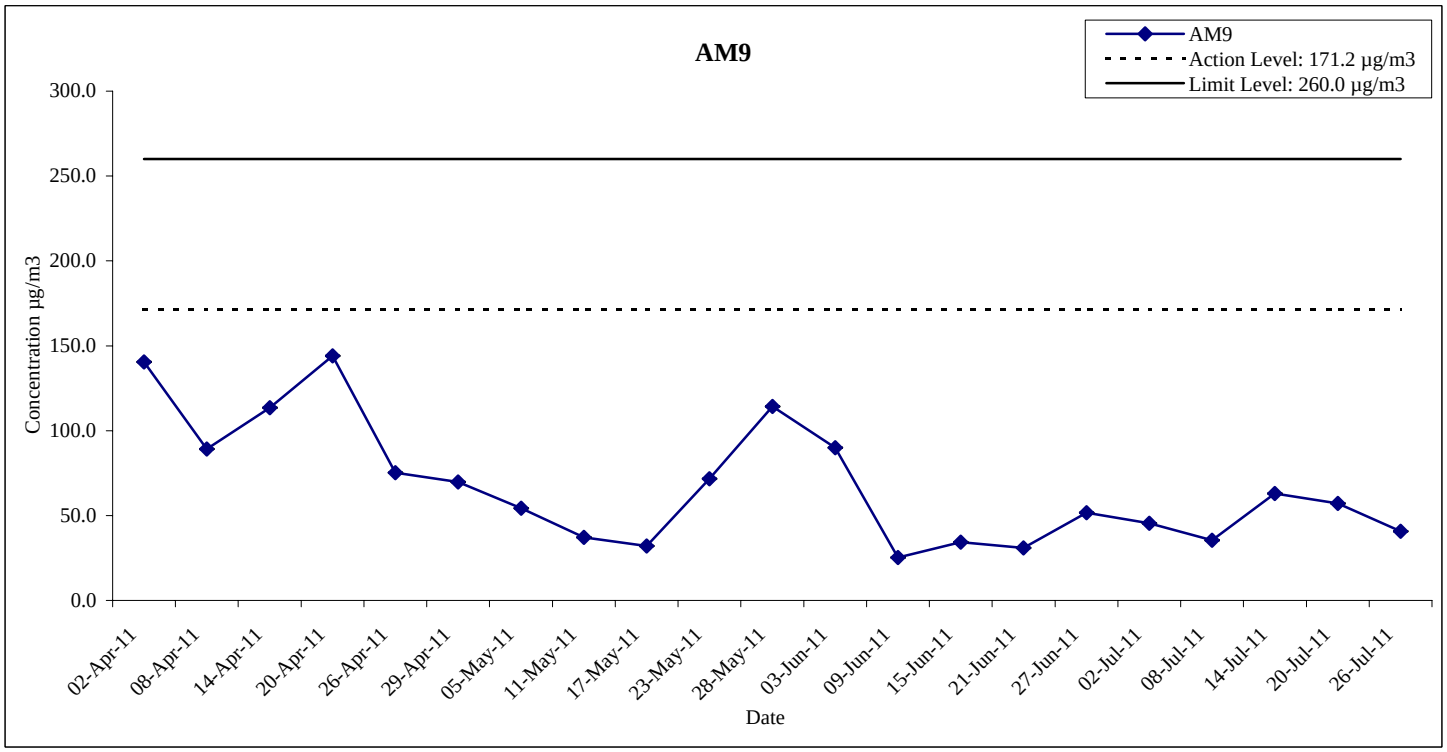

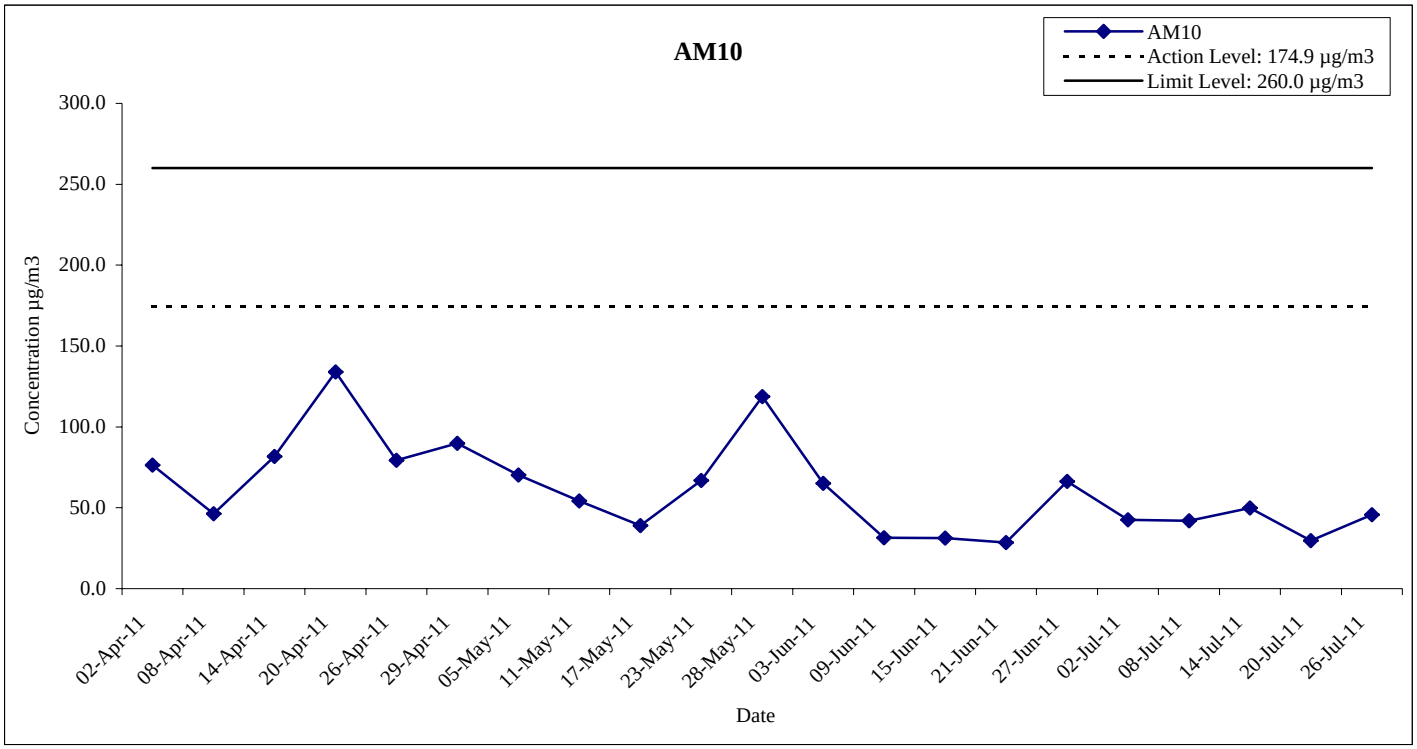



MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM9 and AM10**	**Date**	**2011**
		APPENDIX	**F**

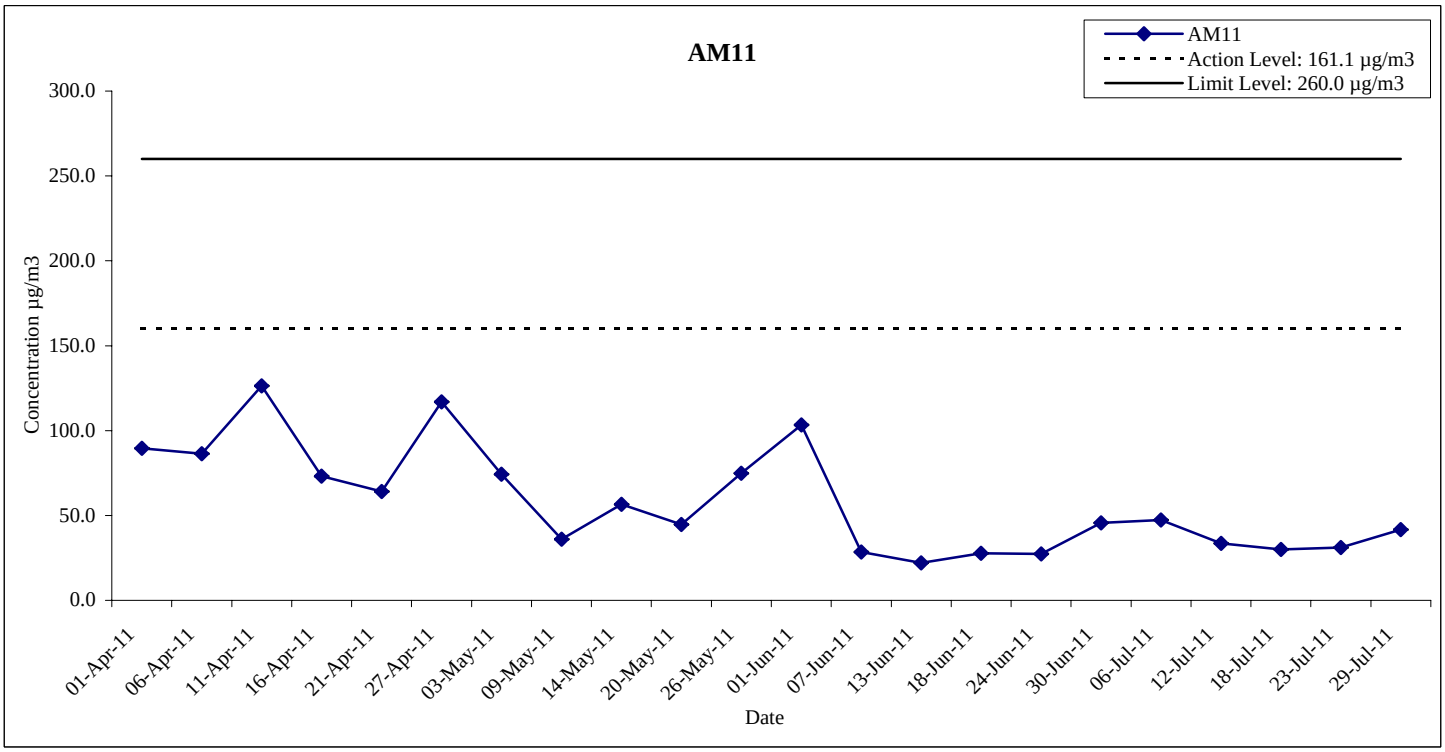

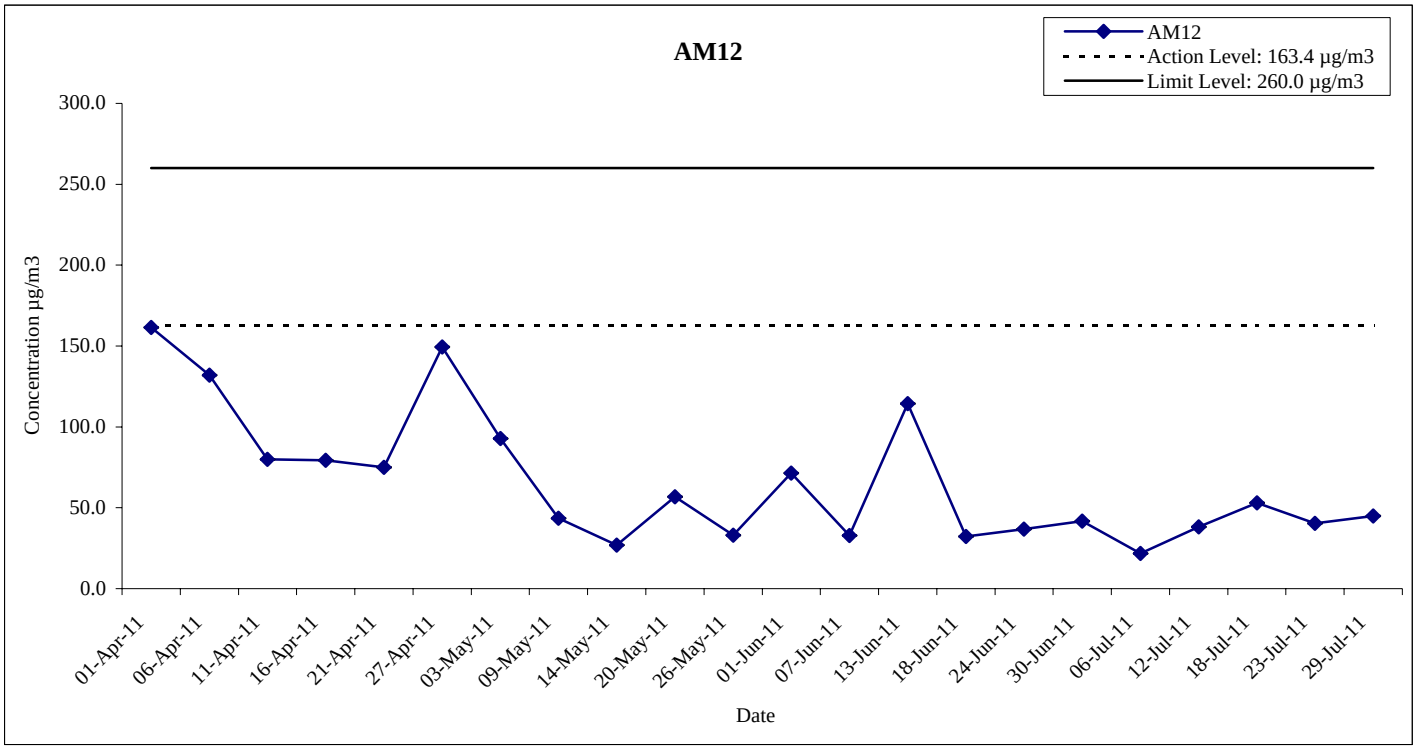



MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM11 and AM12**	**Date**	**2011**
		APPENDIX	**F**

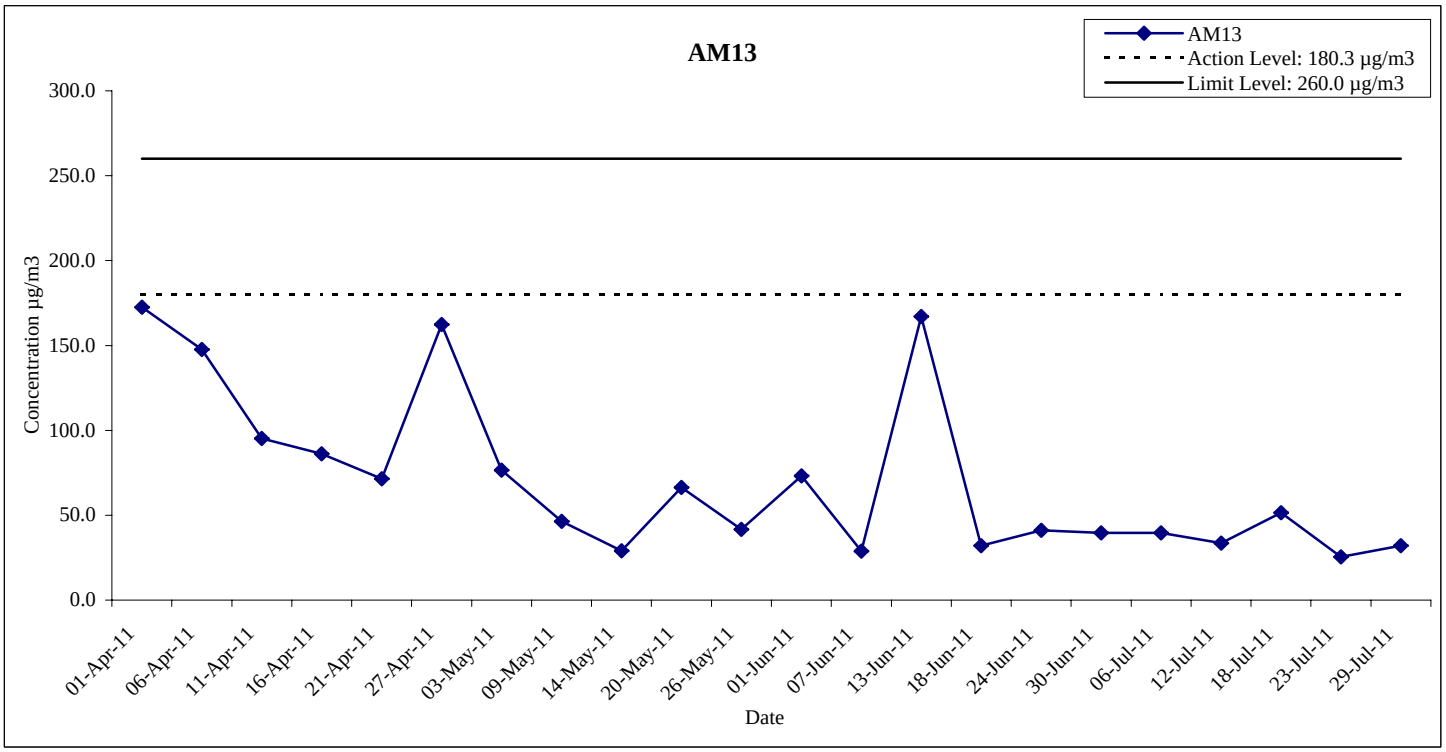

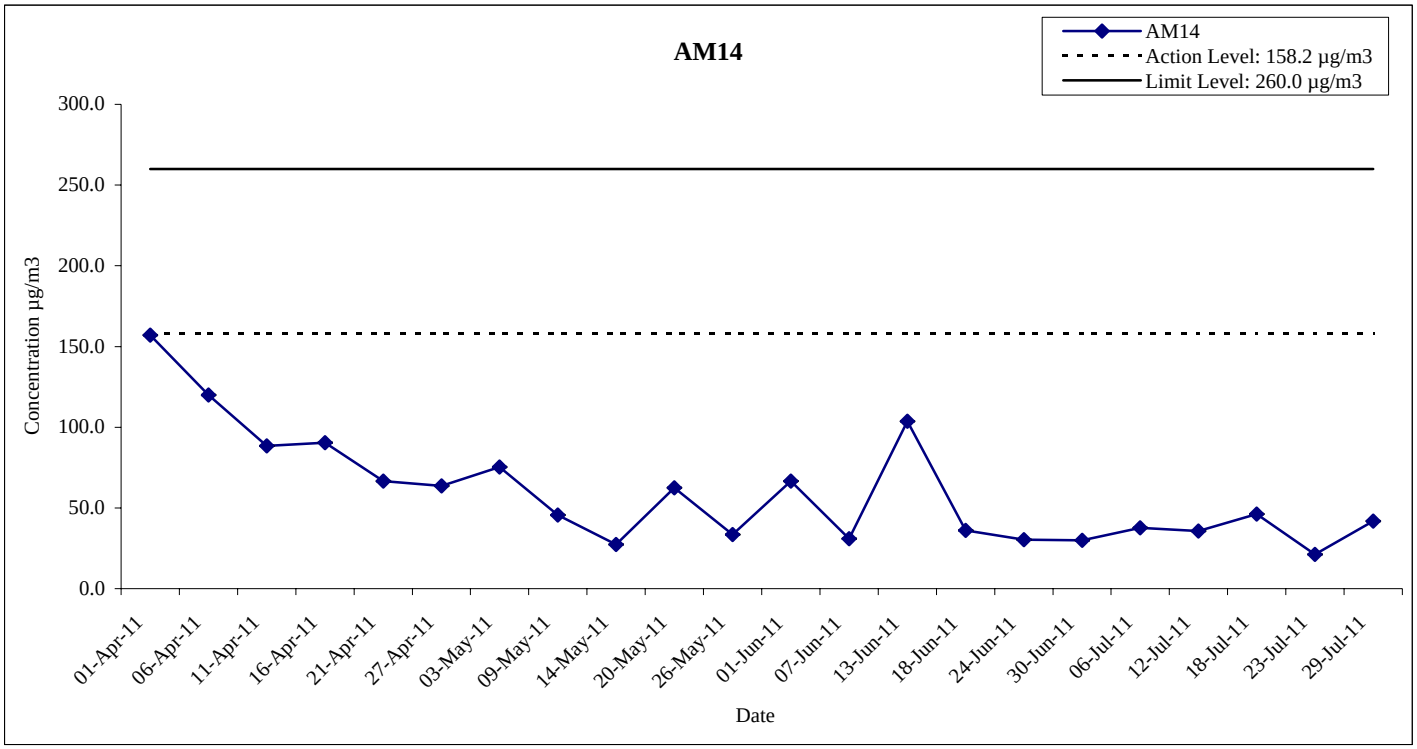


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM13 and AM14**	**Date**	**2011**
		APPENDIX	**F**

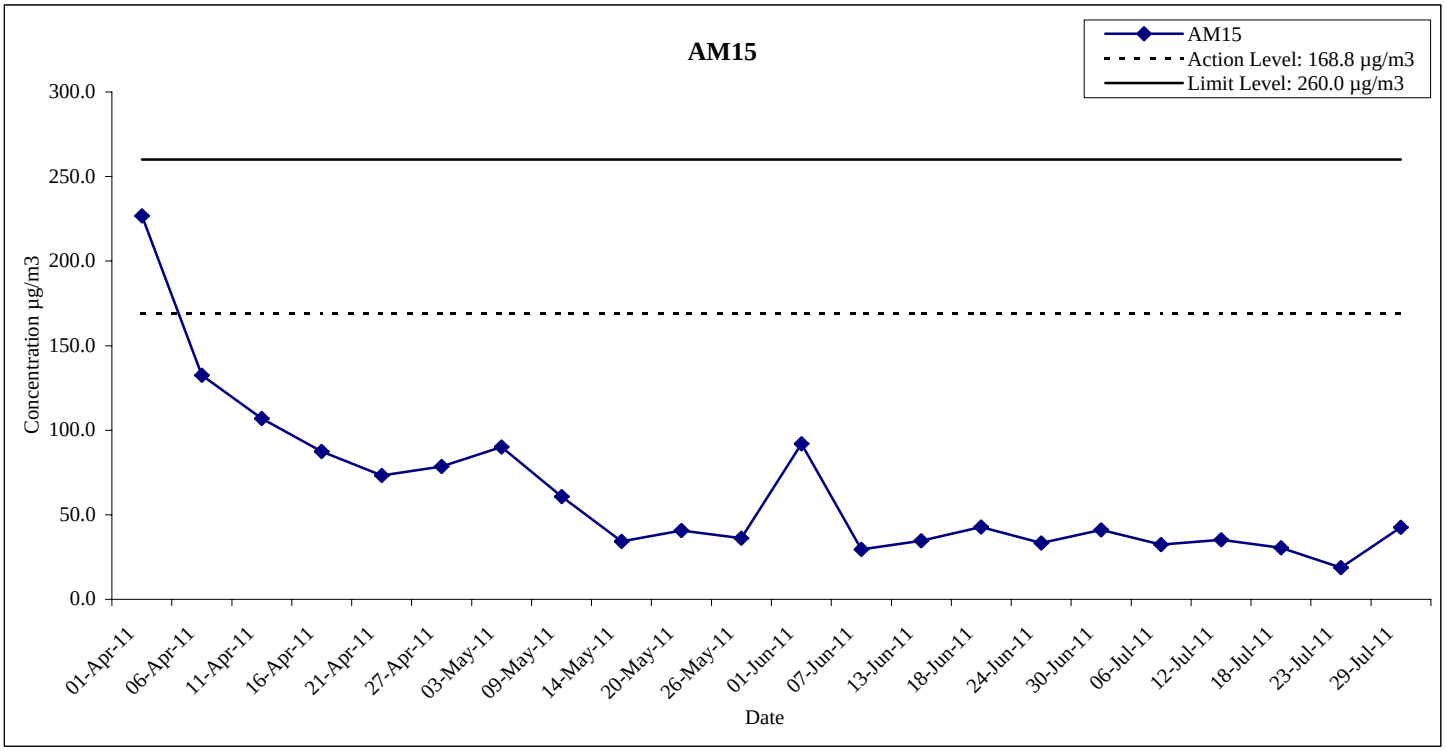

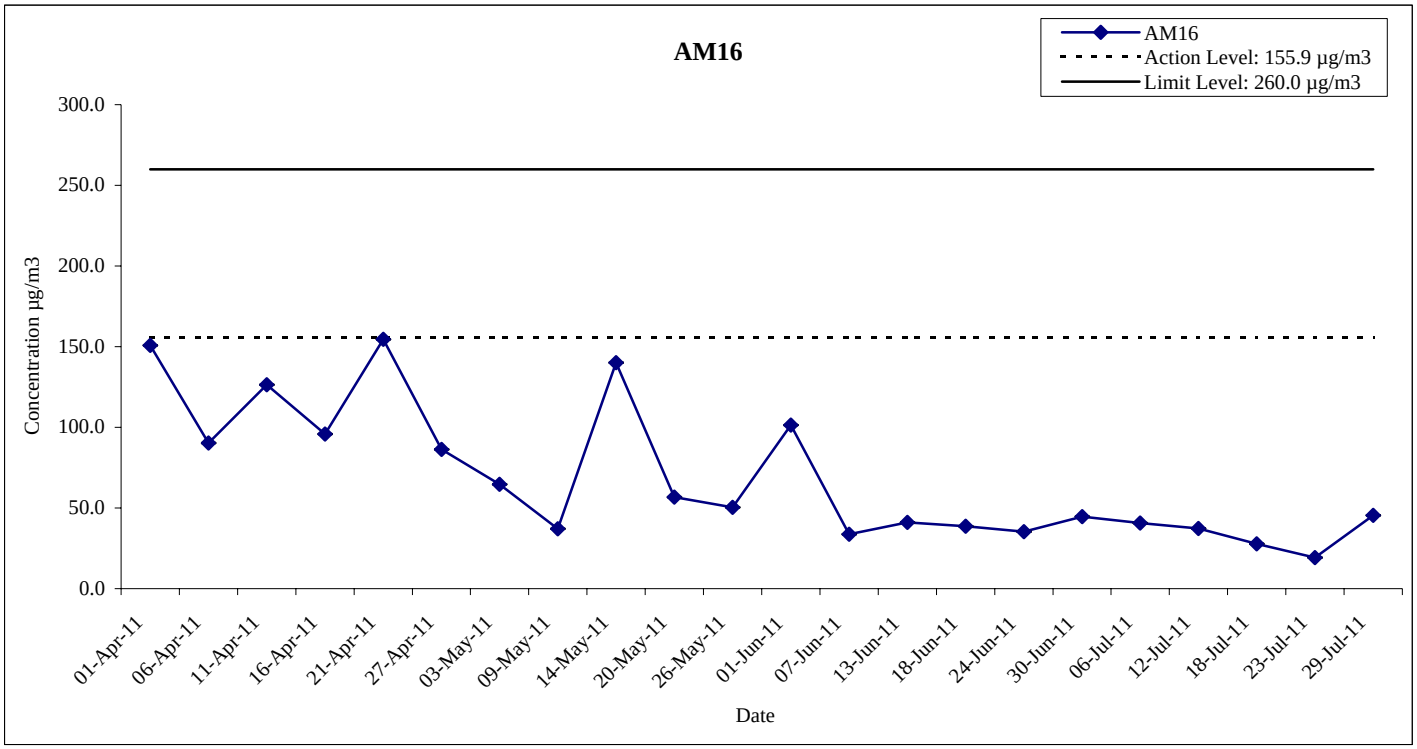

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Results for Location AM15 and AM16**	**Date**	**2011**
		APPENDIX	**F**

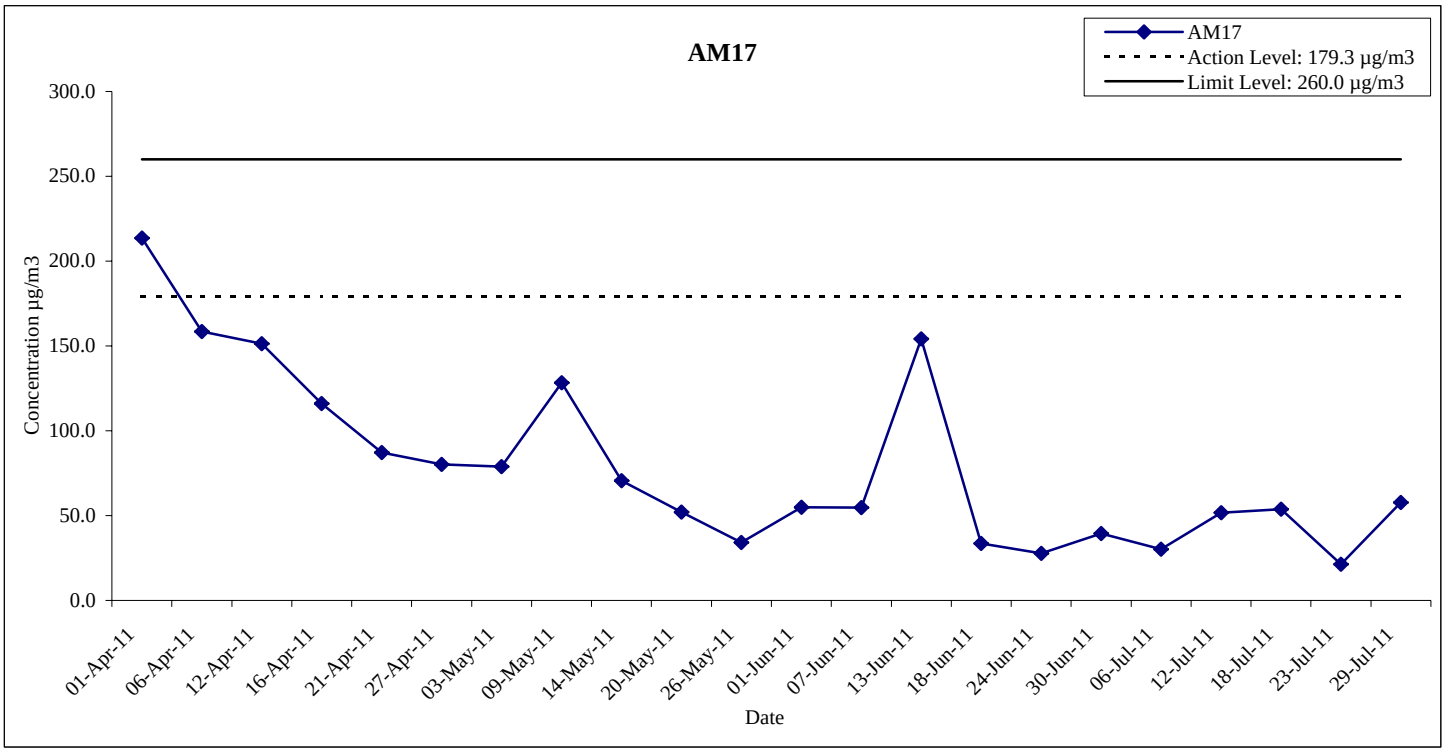

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of 24-hour TSP** **Monitoring Result for Location AM17**	**Date**	**2011**
		APPENDIX	**F**

APPENDIX F: Noise Monitoring Results

- CN1

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	64	75	N
14/07/2011	64	75	N
19/07/2011	64	75	N
27/07/2011	65	75	N

- CN2

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	66	75	N
14/07/2011	68	75	N
19/07/2011	68	75	N
26/07/2011	67	75	N

- CN3

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	53	75	N
13/07/2011	63	75	N
19/07/2011	56	75	N
26/07/2011	55	75	N

- CN4

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	60	75	N
14/07/2011	51	75	N
21/07/2011	59	75	N
28/07/2011	53	75	N

- CN5

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	61	75	N
14/07/2011	63	75	N
19/07/2011	64	75	N
26/07/2011	60	75	N

- CN6

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	65	75	N
14/07/2011	64	75	N
19/07/2011	64	75	N
28/07/2011	60	75	N

- CN7

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	65	75	N
14/07/2011	64	75	N
21/07/2011	64	75	N
26/07/2011	63	75	N

- CN8

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	66	75	N
14/07/2011	82	75	Y
19/07/2011	73	75	N
26/07/2011	75	75	N

- CN9

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	66	75	N
14/07/2011	66	75	N
19/07/2011	67	75	N
26/07/2011	67	75	N

- CN10

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	54	75	N
14/07/2011	63	75	N
19/07/2011	65	75	N
26/07/2011	55	75	N

- CN11

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	55	75	N
14/07/2011	69	75	N
19/07/2011	68	75	N
26/07/2011	61	75	N

- CN12

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	58	75	N
15/07/2011	58	75	N
19/07/2011	62	75	N
28/07/2011	58	75	N

APPENDIX F: Noise Monitoring Results

- CN13

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	64	75	N
14/07/2011	57	75	N
19/07/2011	58	75	N
26/07/2011	61	75	N

- CN14

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	51	75	N
14/07/2011	57	75	N
19/07/2011	53	75	N
26/07/2011	57	75	N

- CN15

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
04/07/2011	70	75	N
14/07/2011	75	75	N
18/07/2011	76	75	Y
25/07/2011	66	75	N

- CN16

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	60	75	N
14/07/2011	56	75	N
18/07/2011	53	75	N
25/07/2011	50	75	N

- CN18

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
04/07/2011	60	75	N
14/07/2011	68	75	N
18/07/2011	73	75	N
25/07/2011	61	75	N

- CN19

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
04/07/2011	65	75	N
14/07/2011	65	75	N
18/07/2011	60	75	N
25/07/2011	66	75	N

- CN20

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	72	75	N
14/07/2011	69	75	N
19/07/2011	69	75	N
26/07/2011	61	75	N

- CN21

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	69	70	N
14/07/2011*	68	70	N
21/07/2011*	69	70	N
28/07/2011*	69	70	N

Remarks: * 14, 21 & 28 July 2011 were school holiday. Noise level measured was for reference only.

- CN22

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	72	75	N
14/07/2011	72	75	N
21/07/2011	72	75	N
28/07/2011	72	75	N

- CN23

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	85	70	Y
14/07/2011*	68	70	N
20/07/2011	77	65	Y
27/07/2011*	82	70	N **

Remarks: * 14 & 27 July 2011 were school holiday. Noise level measured was for reference only.

** Though there was no sensitive use during the period, the Contractor was requested to implement noise mitigation measure to minimize the noise generated.

Note:

- Impact monitoring at Tsuen Wan Lutheran School (CN 17) had been temporarily suspended since December 2010 due to school closure. Monitoring at this location will be resumed subject to confirmation of school operation or other noise sensitive use at CN 17.
- A correction factor has been applied at CN19 to take into account the noise barrier effect. The correction factor was agreed with IEC according to Section 3.11 of the EM&A Manual.
- Noise limit level of CN21, CN23, CN24, CN25, CN26 & CN29, which are school, is 70dB(A) on normal weekdays and 65dB(A) during examination period.

APPENDIX F: Noise Monitoring Results

- CN24

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	67	70	N
14/07/2011*	66	70	N
21/07/2011*	67	70	N
28/07/2011*	66	70	N

Remarks: * 14, 21 & 28 July 2011 were school holiday.
Noise level measured was for reference only.

- CN25

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	70	70	N
14/07/2011*	69	70	N
21/07/2011*	70	70	N
25/07/2011*	70	70	N

Remarks: * 14, 21 & 25 July 2011 were school holiday.
Noise level measured was for reference only.

- CN26

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	68	70	N
14/07/2011*	69	70	N
21/07/2011*	70	70	N
27/07/2011*	71	70	N

Remarks: * 14, 21 & 27 July 2011 were school holiday.
Noise level measured was for reference only.

- CN27

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	65	75	N
14/07/2011	68	75	N
21/07/2011	67	75	N
28/07/2011	67	75	N

- CN28

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
08/07/2011	75	75	N
14/07/2011	73	75	N
21/07/2011	72	75	N
27/07/2011	72	75	N

- CN29

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	69	70	N
14/07/2011*	70	70	N
21/07/2011*	70	70	N
28/07/2011*	72	70	N

Remarks: * 14, 21 & 28 July 2011 were school holiday.
Noise level measured was for reference only.

- CN30

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
05/07/2011	71	75	N
14/07/2011	69	75	N
19/07/2011	69	75	N
26/07/2011	69	75	N

- CN31

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
08/07/2011	73	75	N
14/07/2011	75	75	N
19/07/2011	74	75	N
26/07/2011	77	75	Y

- CN32

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	76	75	Y
14/07/2011	79	75	Y
21/07/2011	82	75	Y
28/07/2011	78	75	Y


- CN33


Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	75	75	N
14/07/2011	75	75	N
19/07/2011	75	75	N
26/07/2011	79	75	Y


- CN34

Date	Noise Monitoring Results	Limit Level	Exceedance?
	Leq, dB(A)	Leq, dB(A)	
06/07/2011	73	75	N
14/07/2011	73	75	N
21/07/2011	72	75	N
26/07/2011	72	75	N


Note:
- Noise limit level of CN21, CN23, CN24, CN25, CN26 & CN29, which are school, is 70dB(A) on normal weekdays and 65dB(A) during examination period.

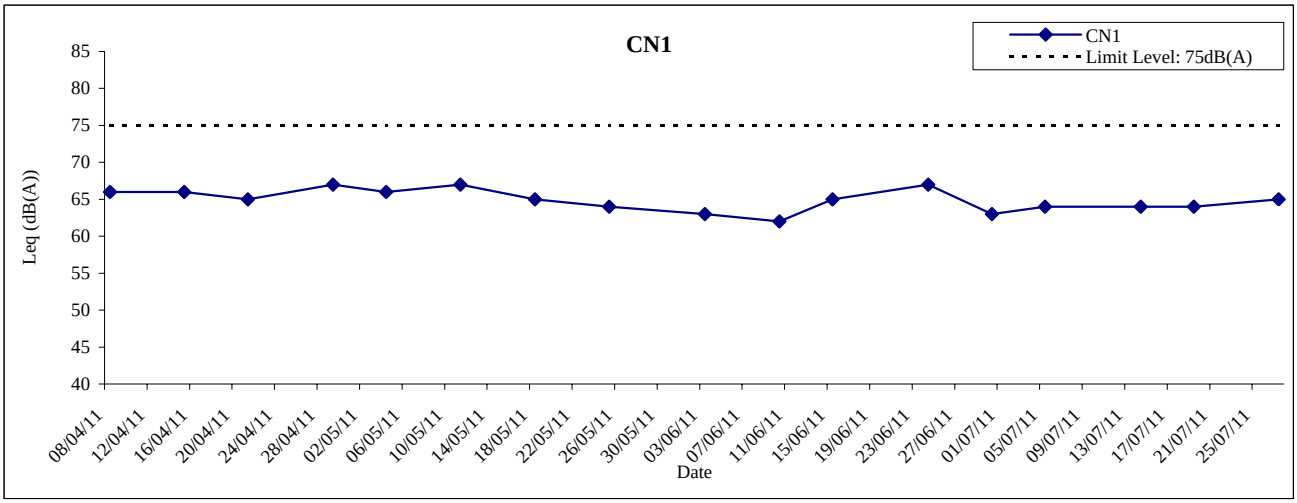


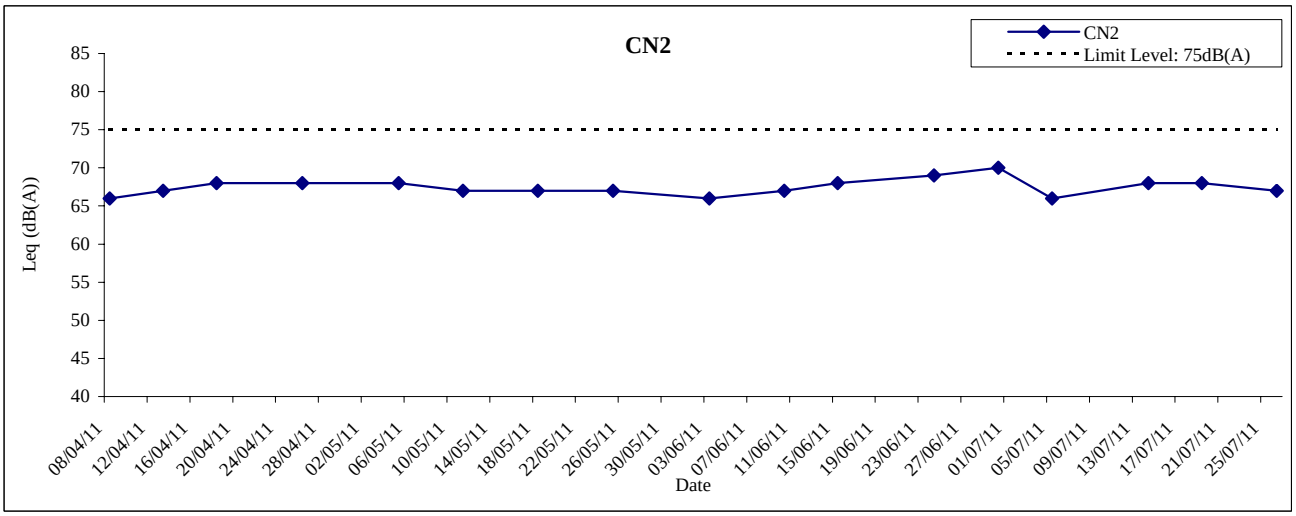


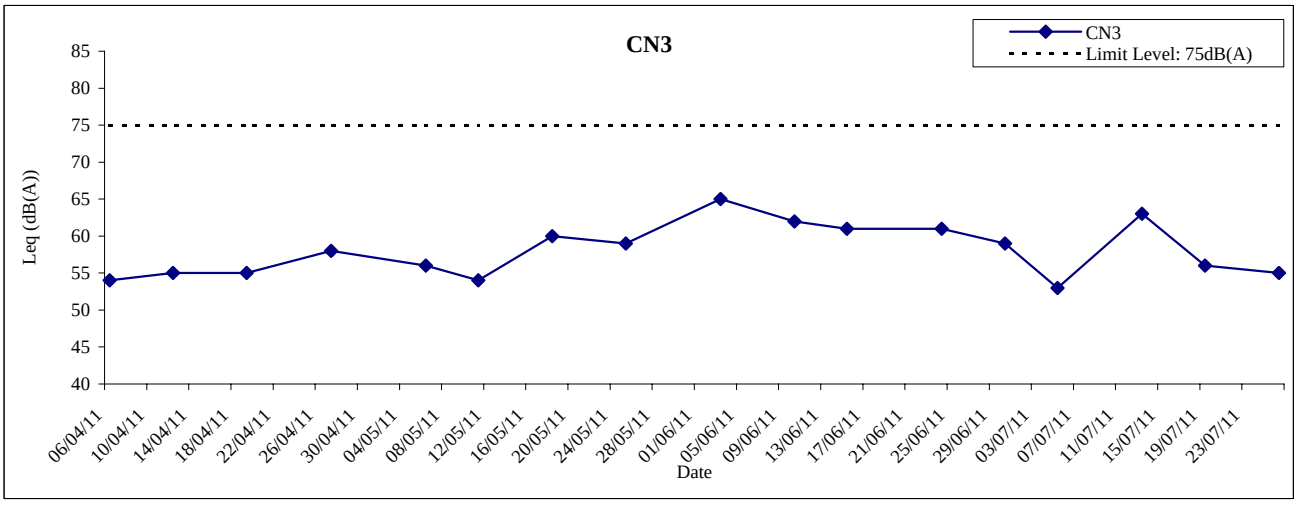


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN1, CN2 and CN3**	**Date**	**2011**
		APPENDIX	**F**

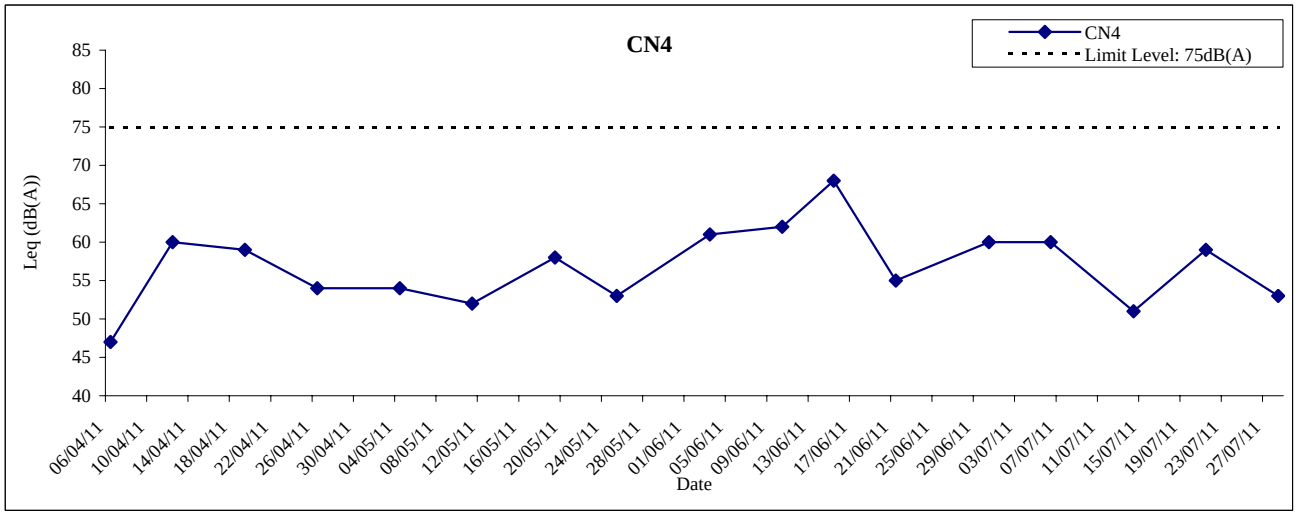


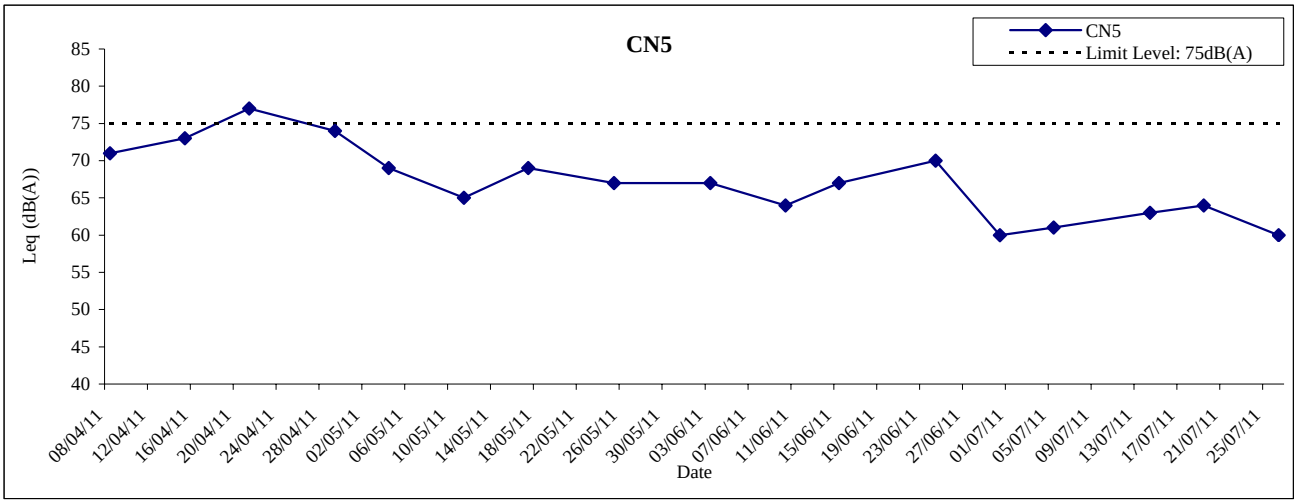


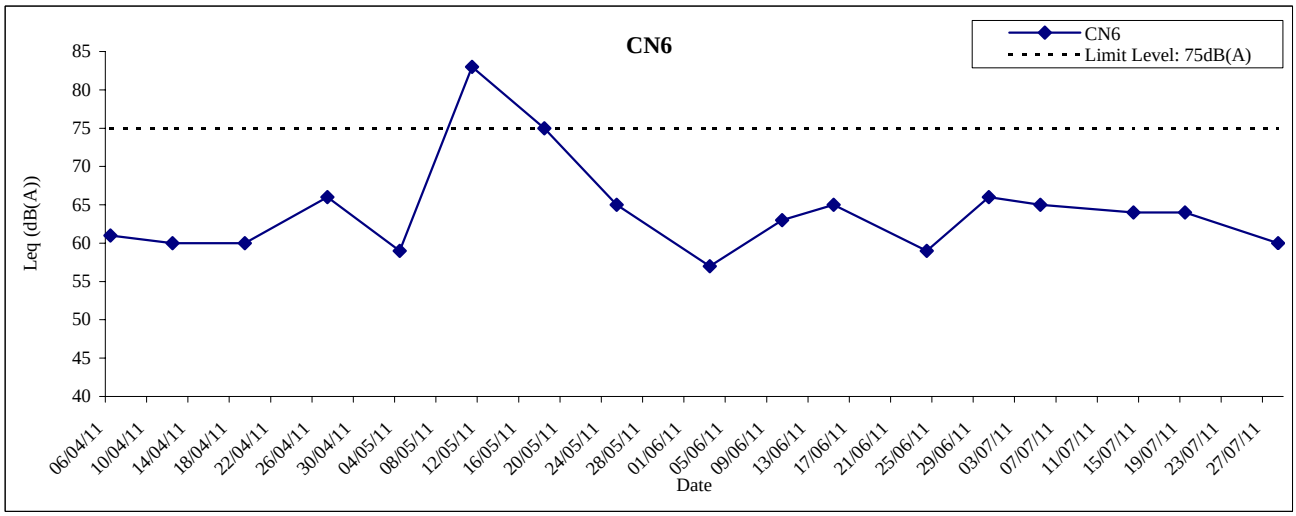


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN4, CN5 and CN6**	**Date**	**2011**
		APPENDIX	**F**

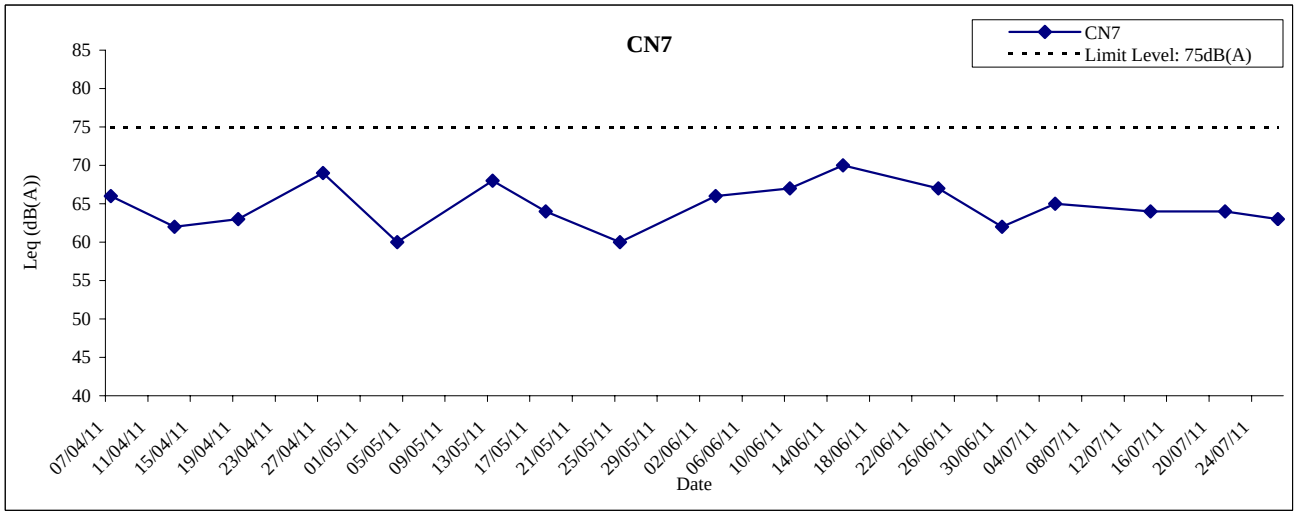


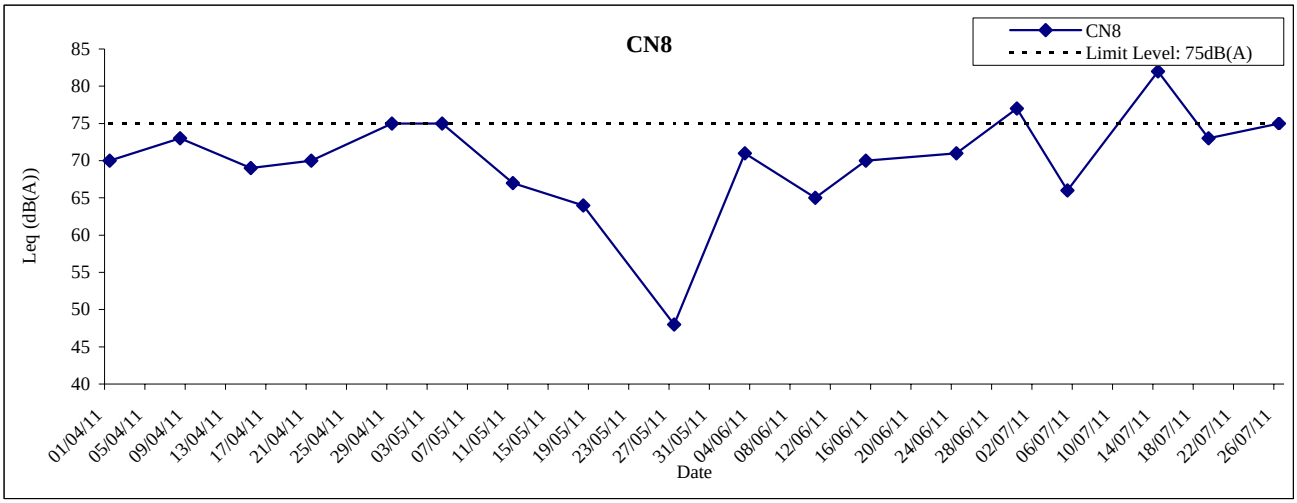


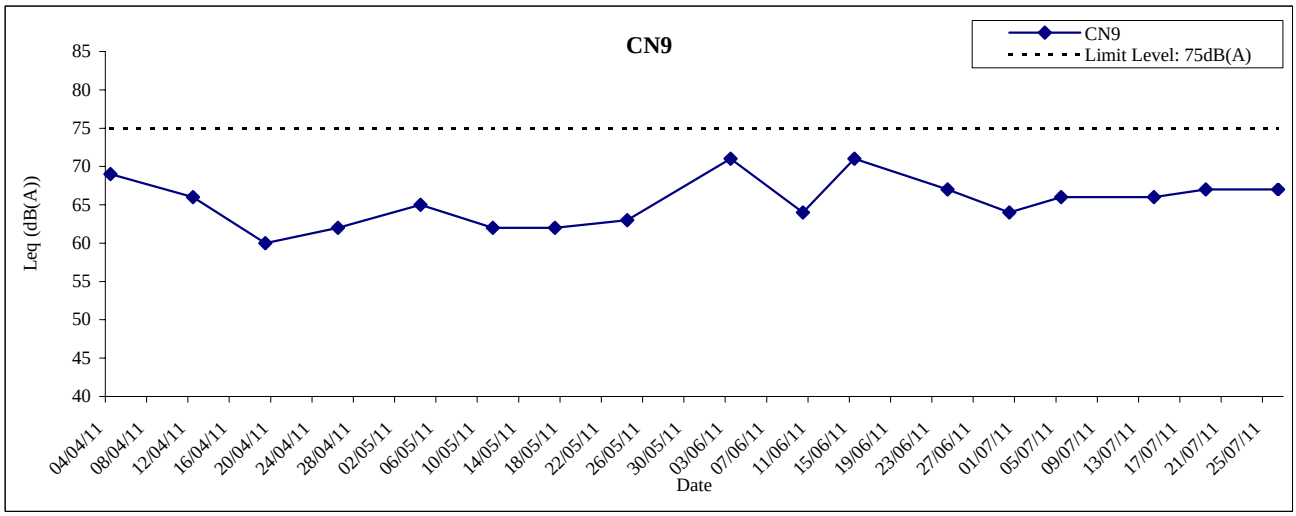


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN7, CN8 and CN9**	**Date**	**2011**
		APPENDIX	**F**

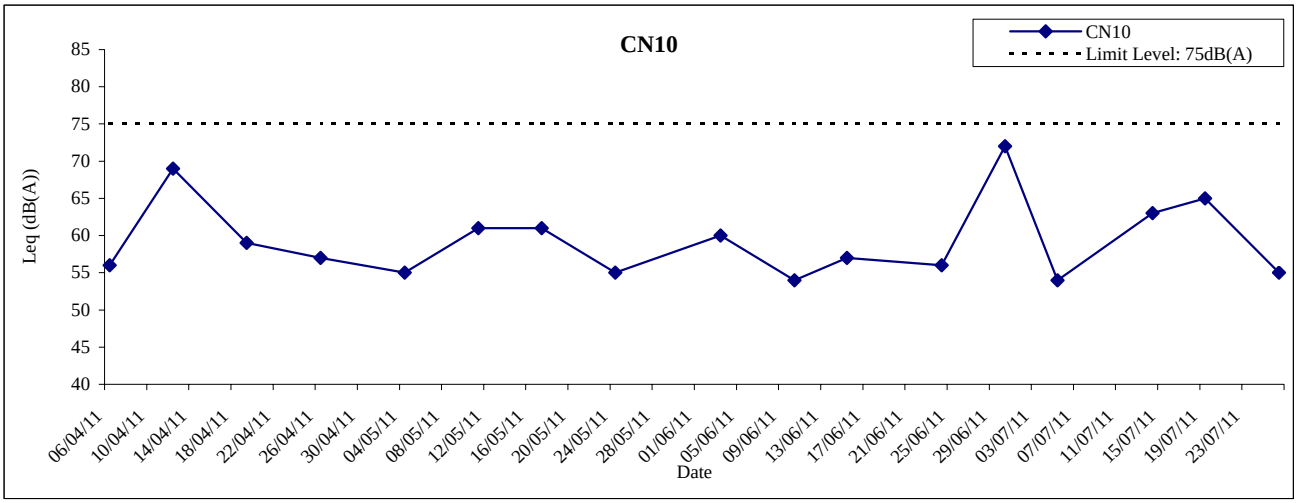


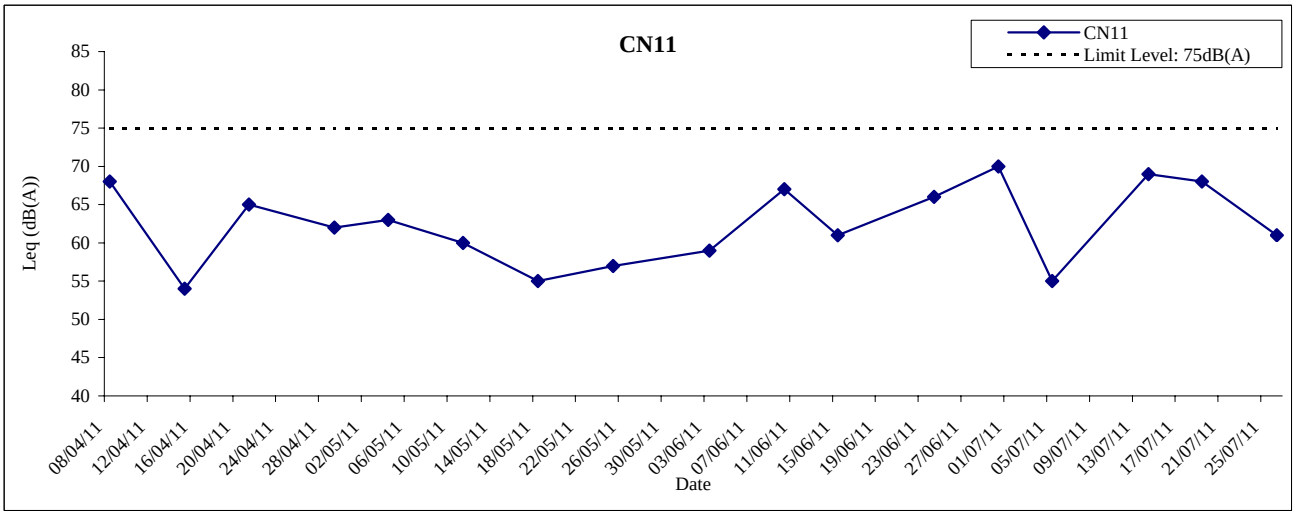


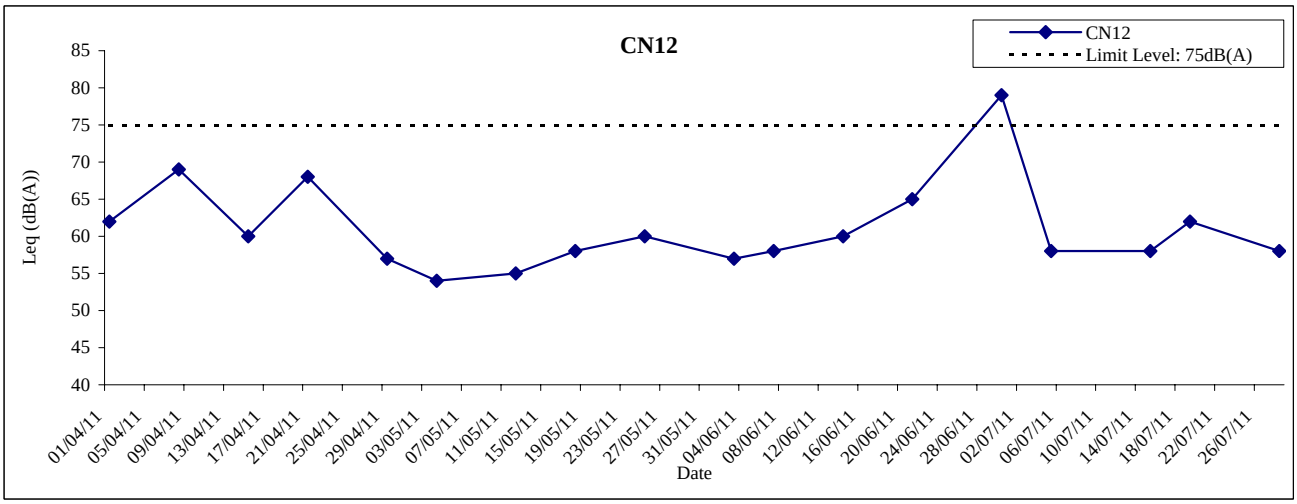


MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN10, CN11 and CN12**	**Date**	**2011**
		APPENDIX	**F**

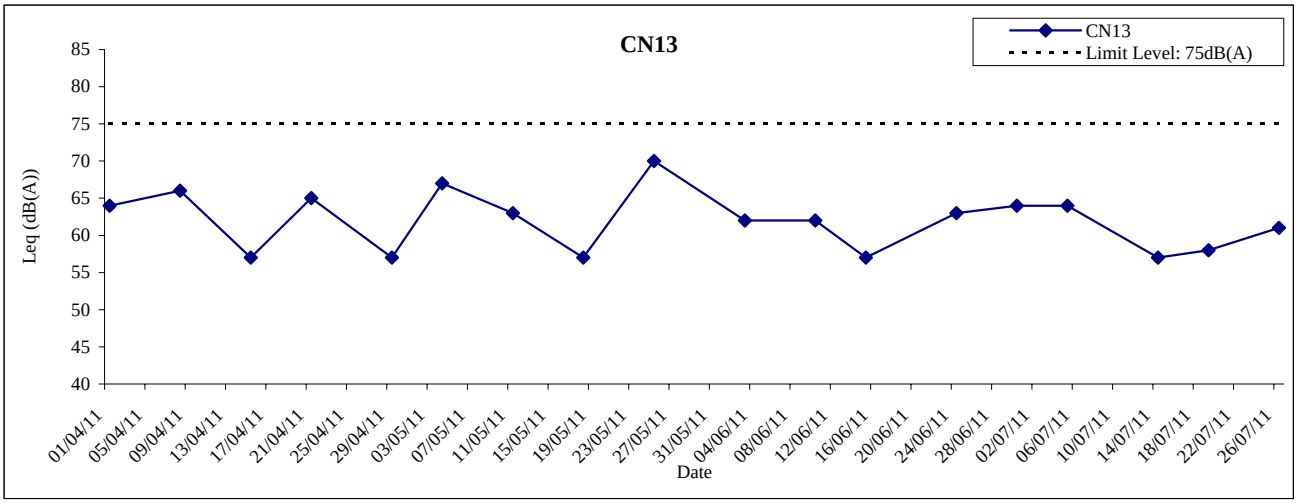


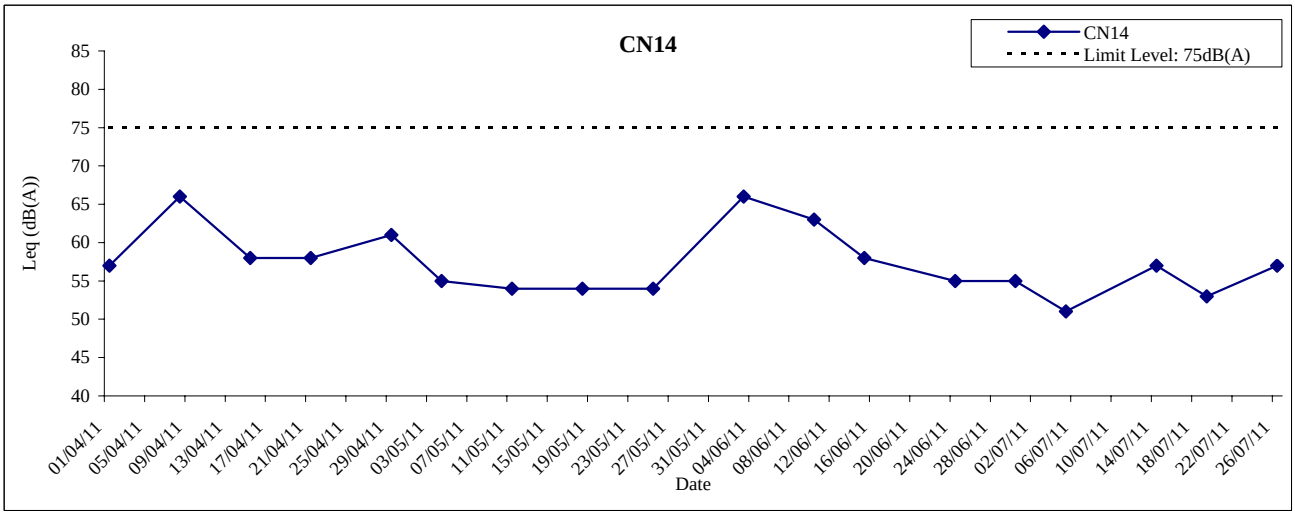


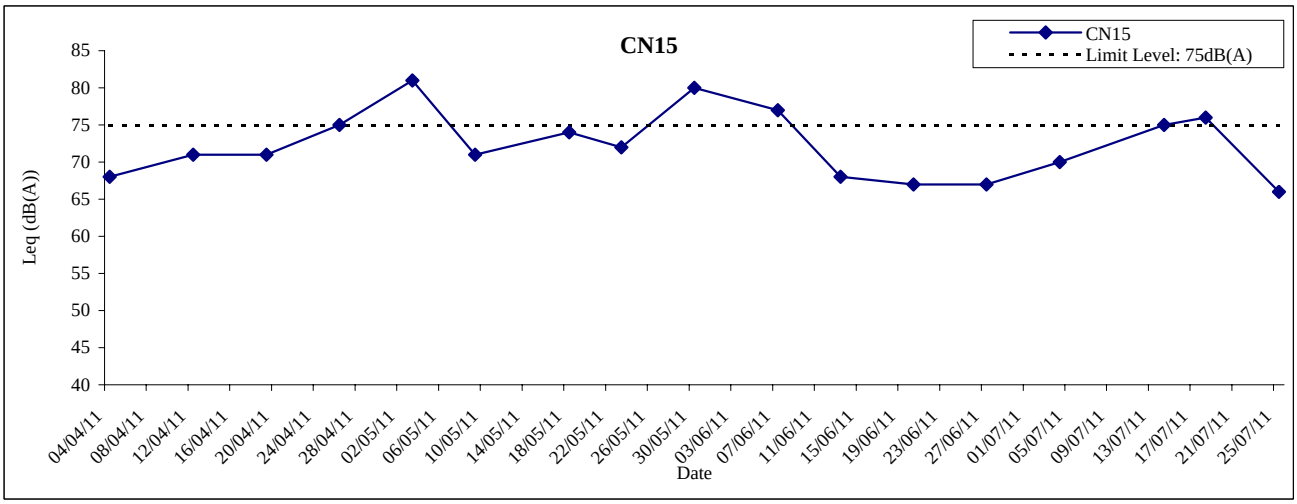

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN13, CN14 and CN15**	**Date**	**2011**
		APPENDIX	**F**

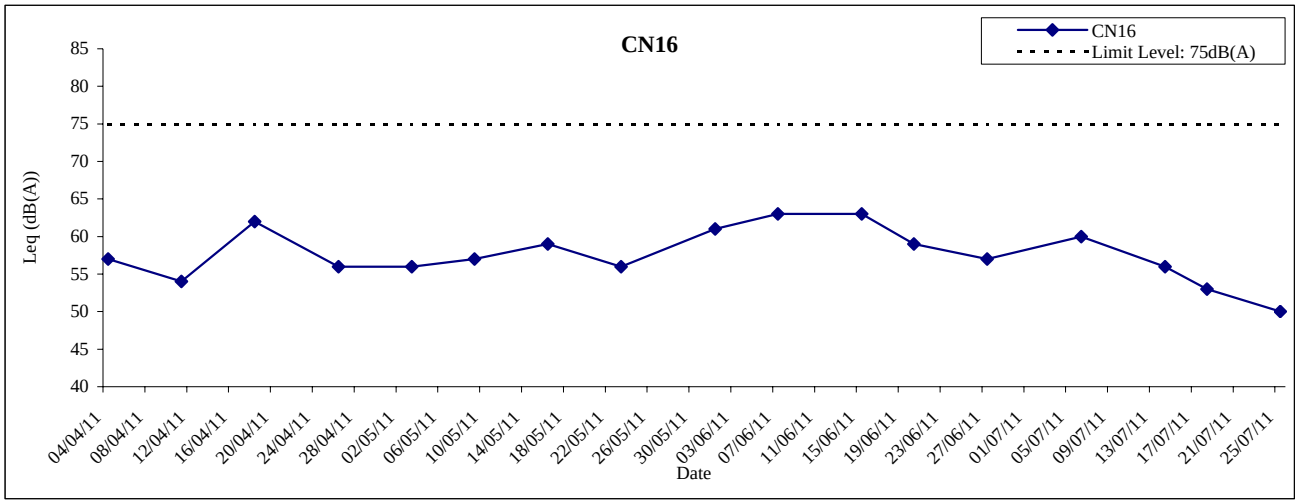

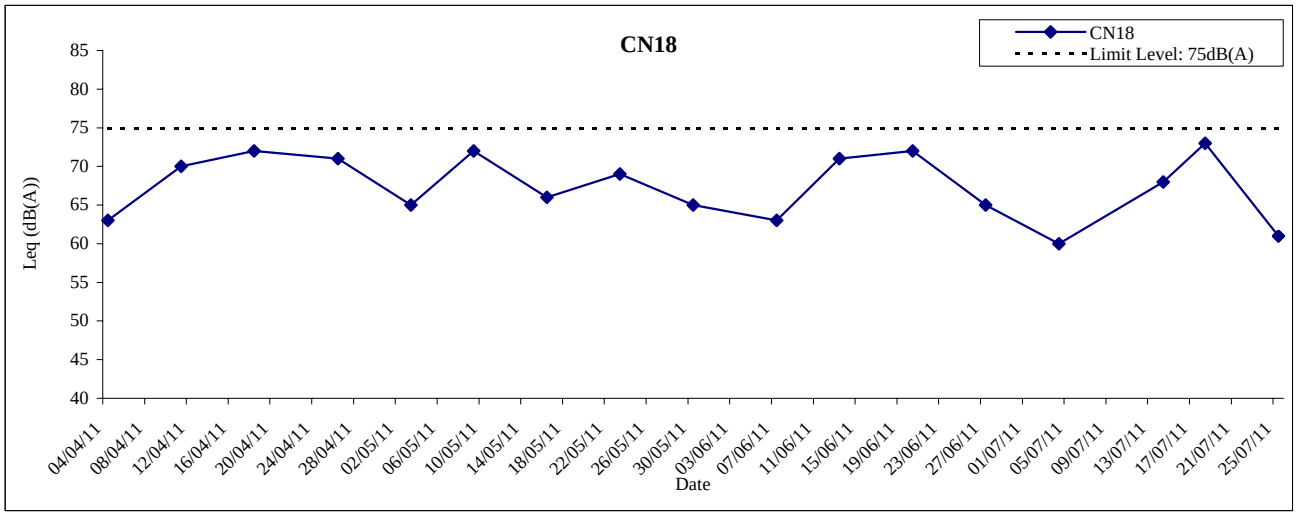


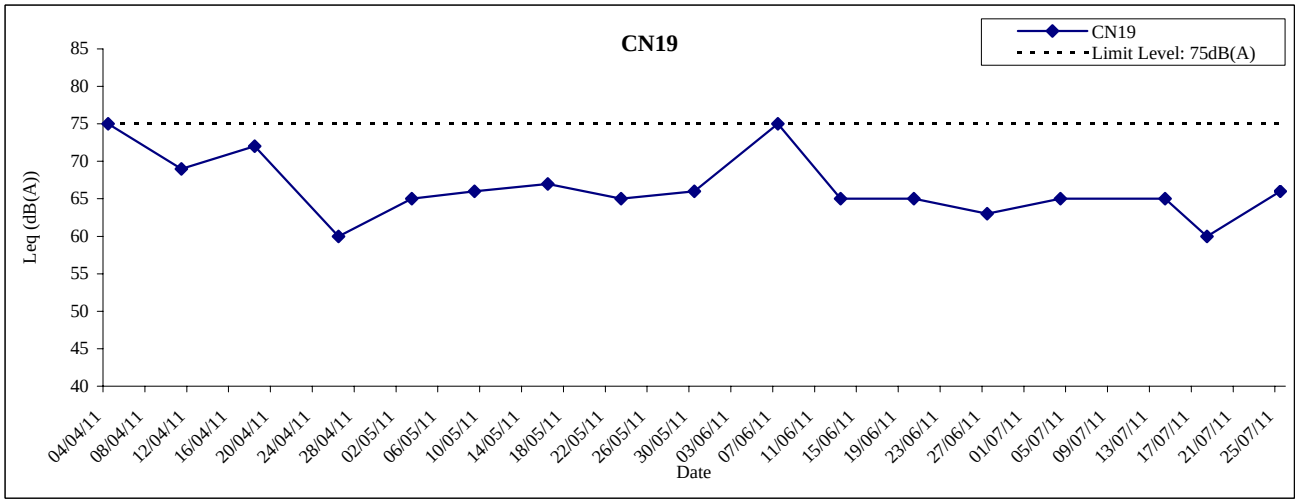



Remarks:

A correction factor has been applied at CN19 to take into account the noise barrier effect. The correction factor was agreed with IEC according to Section 3.11 of the EM&A Manual.

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN16, CN18 and CN19**	**Date**	**2011**
		APPENDIX	**F**

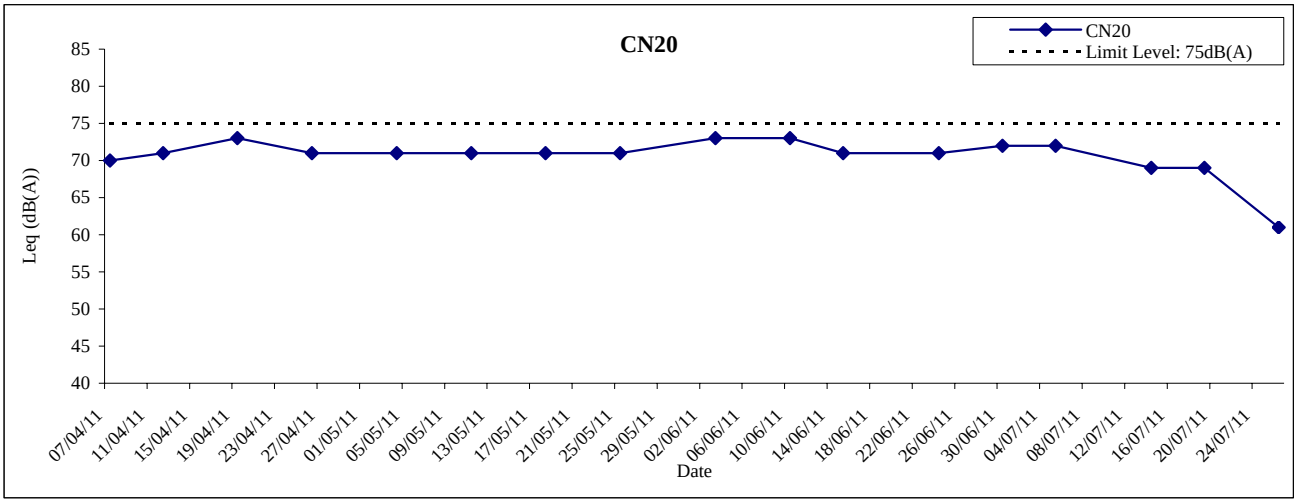


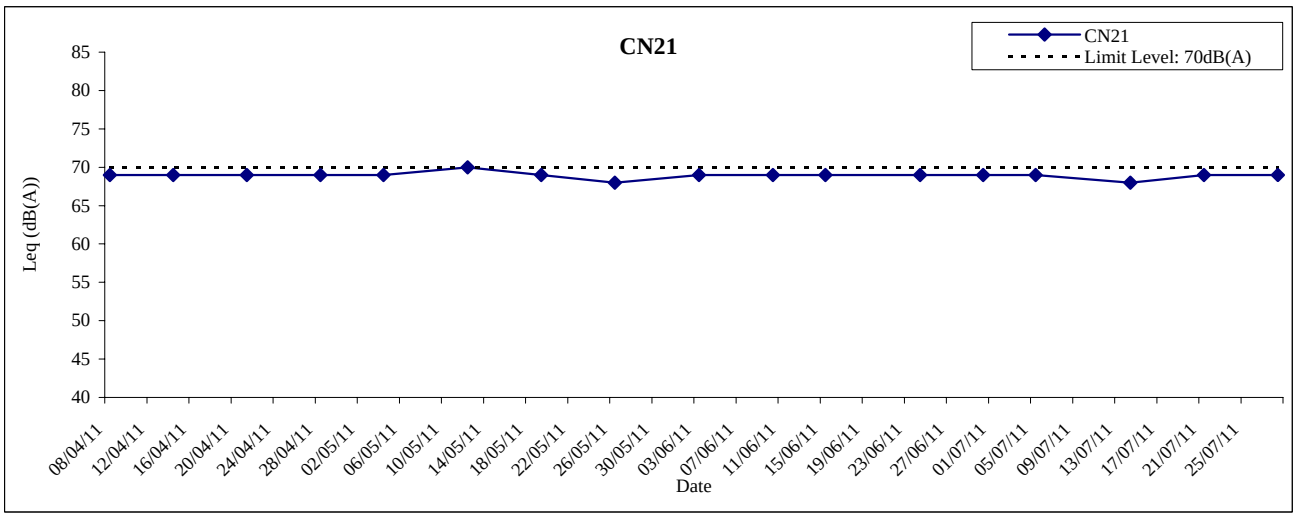


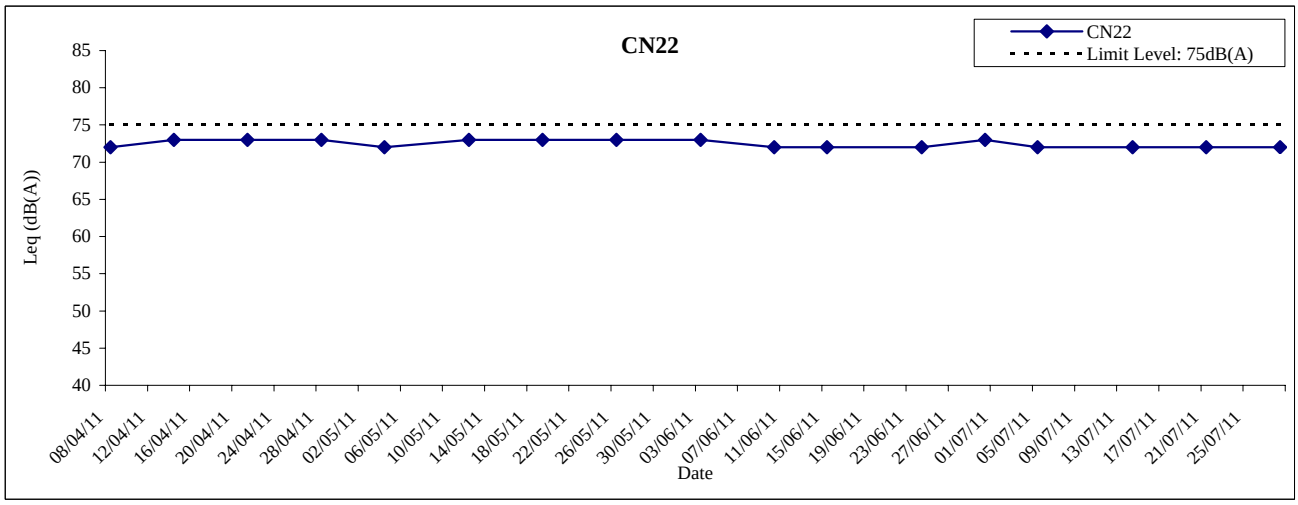


Remarks:
Noise limit level of CN21, which is school, is 70dB(A) on normal weekdays and 65dB(A) during examination period.

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN21, CN22 and CN23**	**Date**	**2011**
		APPENDIX	**F**

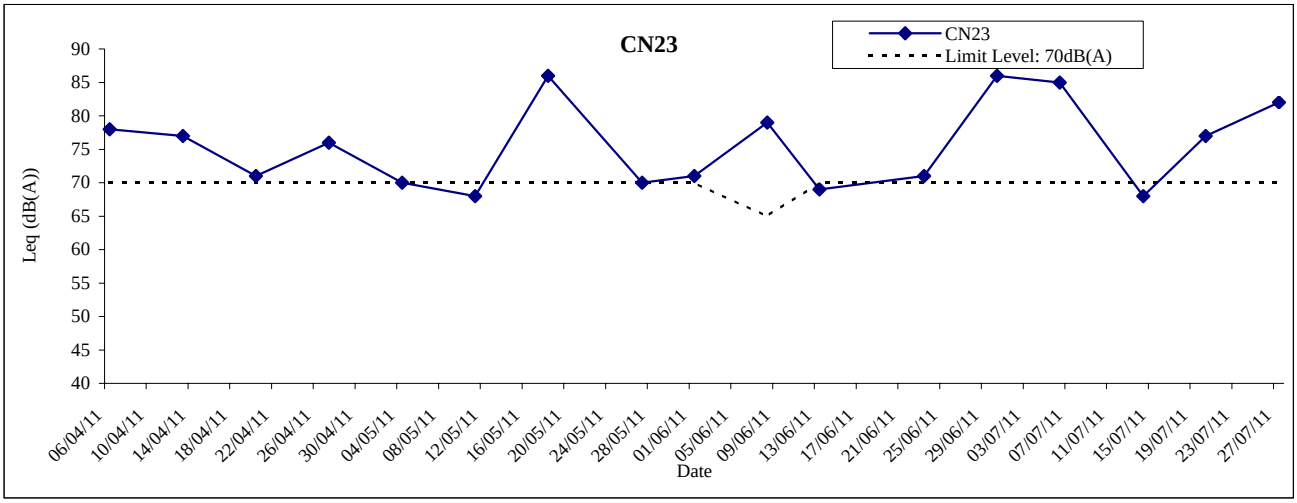


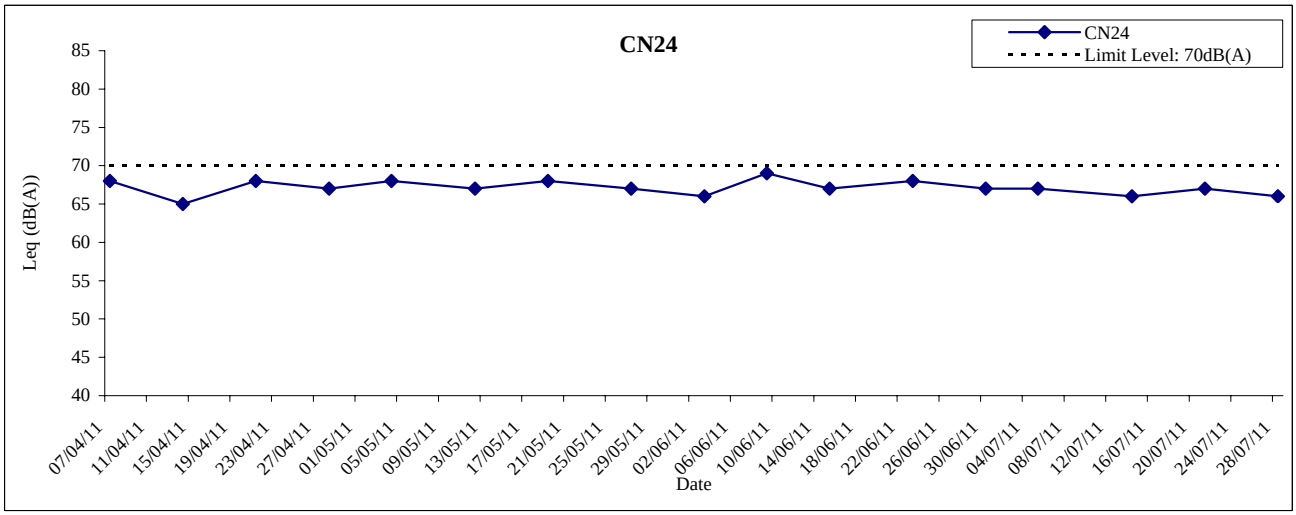


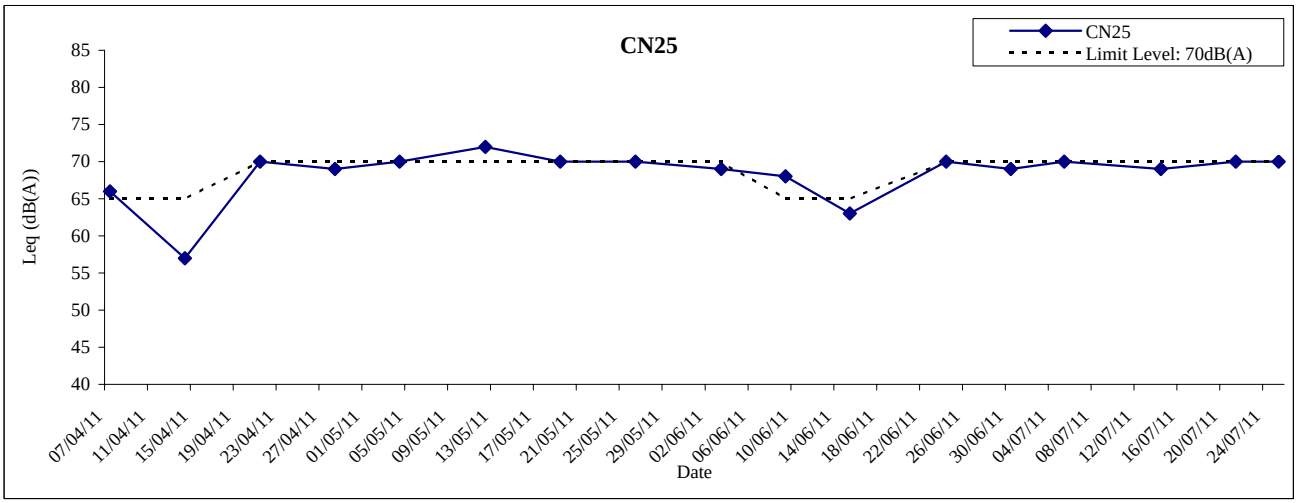


Remarks:
-Noise limit level of CN23, CN24 & CN25, which are school, is 70dB(A) on normal weekdays and 65dB(A) during examination period.

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN23, CN24 and CN25**	**Date**	**2011**
		APPENDIX	**F**

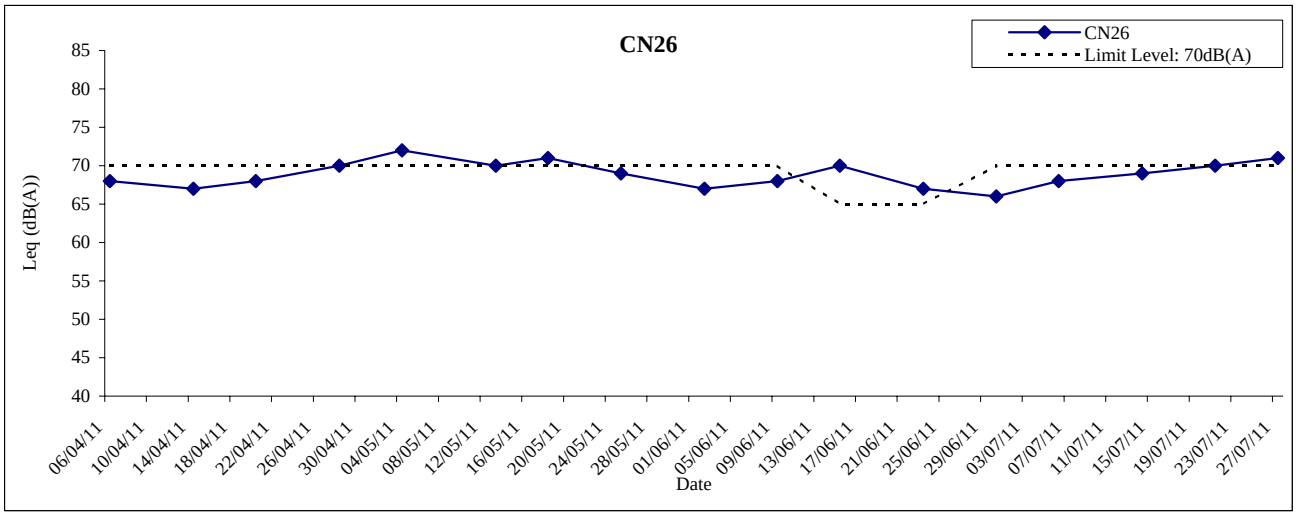


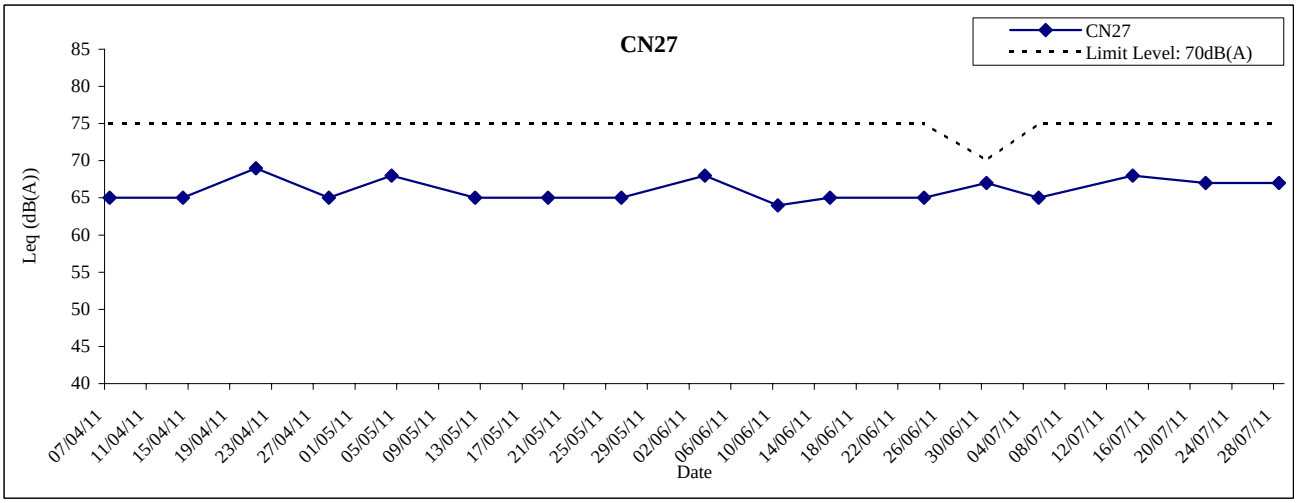


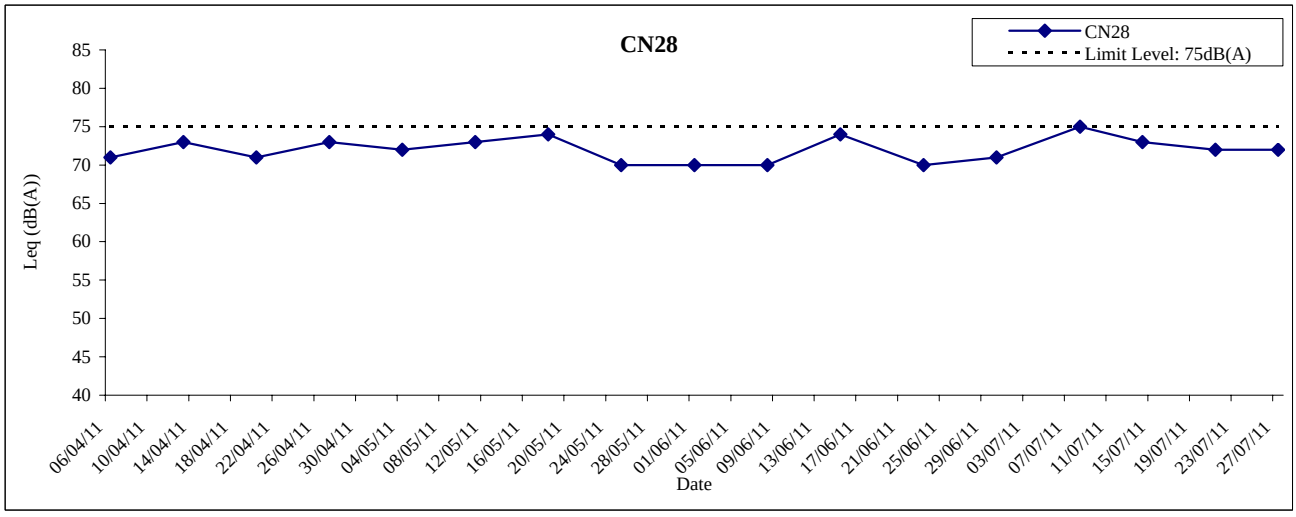


Remarks:
Noise limit level of CN26, which is school, is 70dB(A) on normal weekdays and 65dB(A) during examination period.

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN26, CN27 and CN28**	**Date**	**2011**
		APPENDIX	**F**

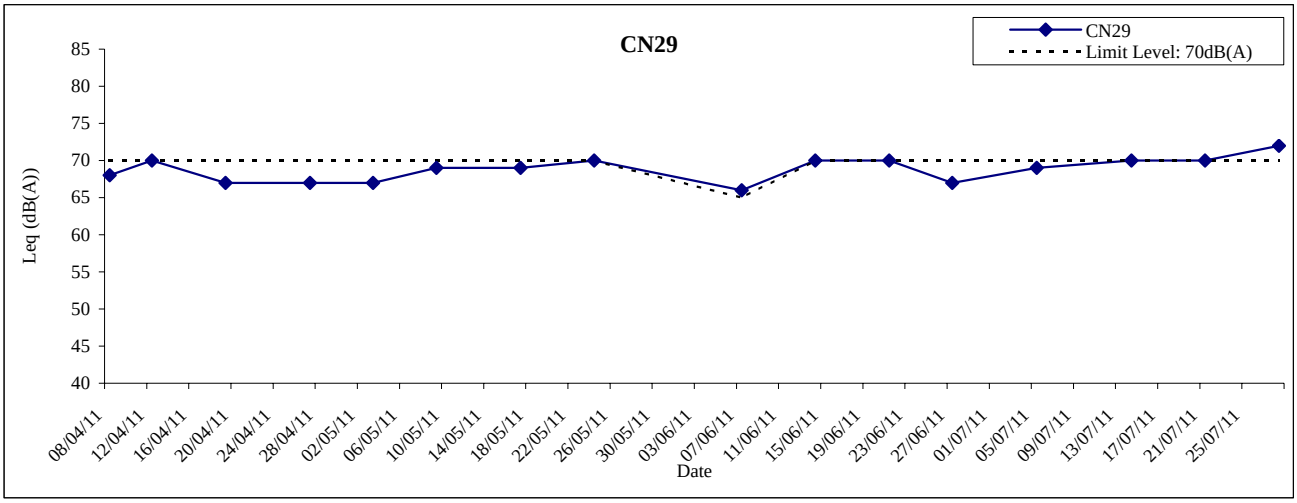


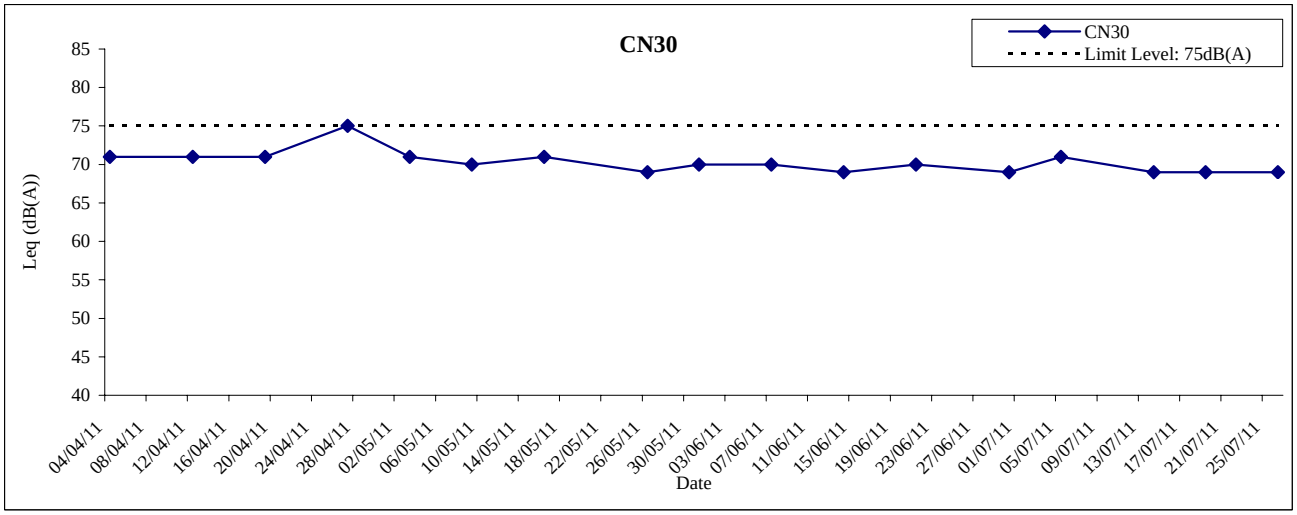


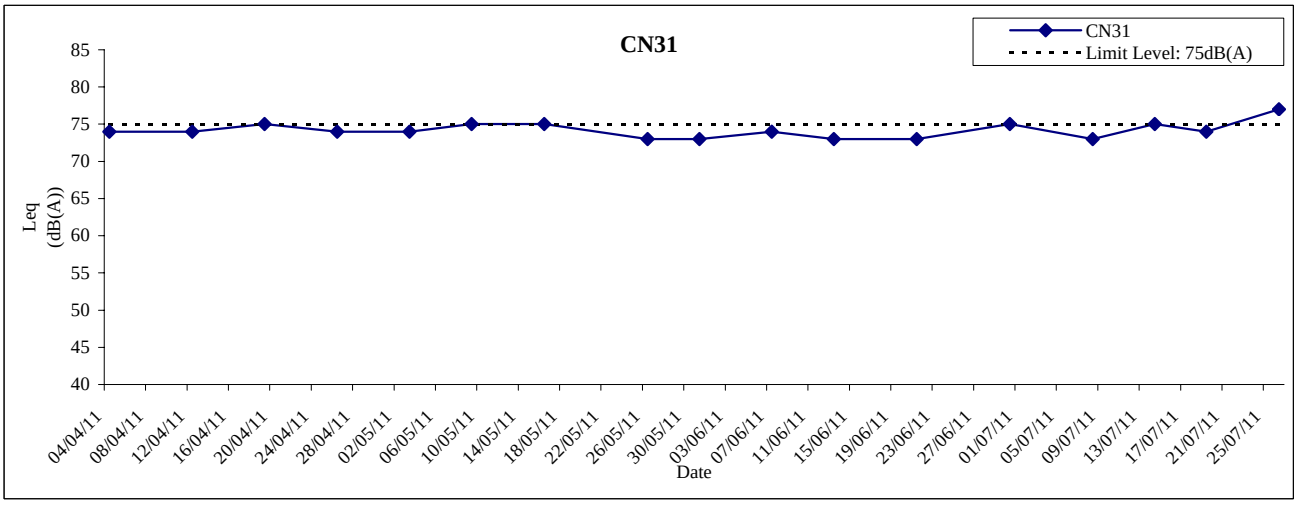


Remarks:
Noise limit level of CN29, which is school, is 70dB(A) on normal weekdays and 65dB(A) during examination period.

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN29, CN30 and CN31**	**Date**	**2011**
		APPENDIX	**F**

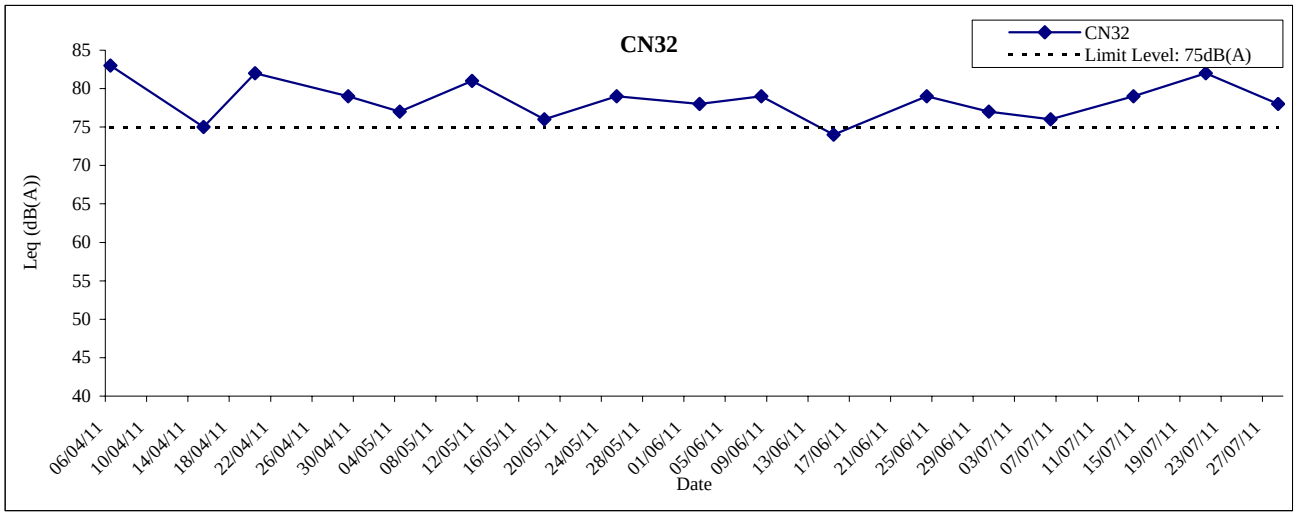

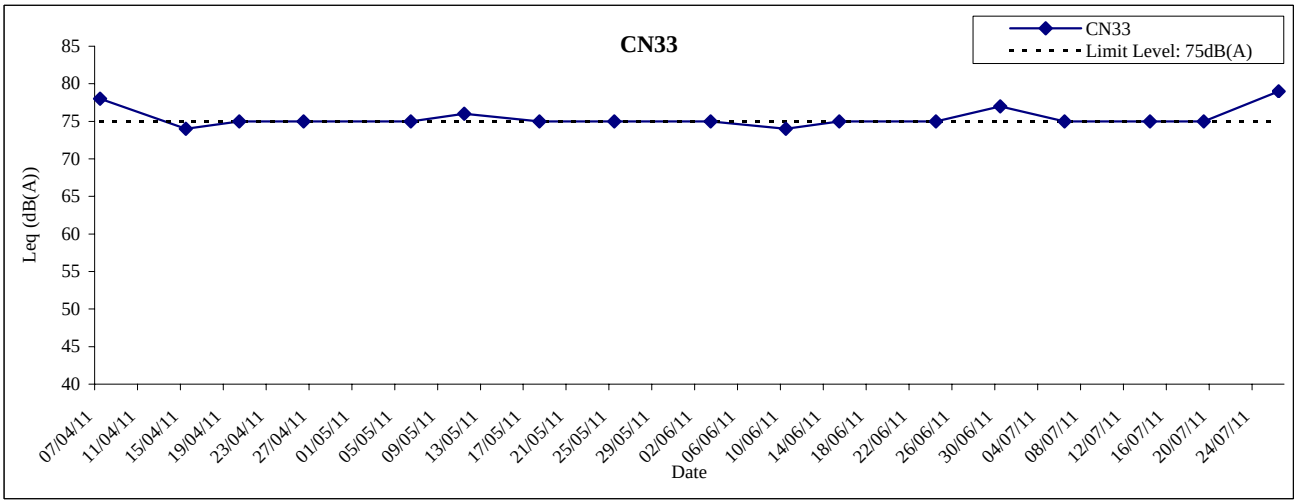

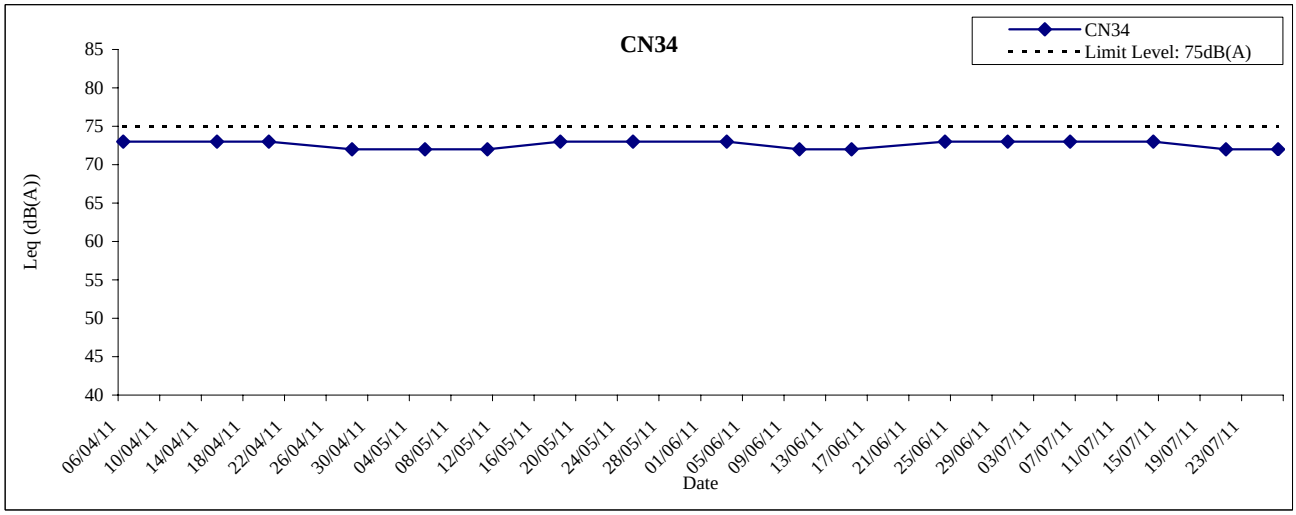

MTR	Hong Kong Section of Guangzhou-Shenzhen-Hong Kong Express Rail Link **Graphical Presentation of Noise** **Monitoring Results for Location CN32, CN33 and CN34**	**Date**	**2011**
		APPENDIX	**F**

Appendix G

Bird Species and Abundance Recorded during Avifauna Survey

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: MPV
Survey Site: MPV-1
Survey Date: 14 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location												Sub-total	Walk Transect
			MPV-1/P1	MPV-1/P2	MPV-1/P3	MPV-1/P4	MPV-1/P5	MPV-1/P6	MPV-1/P7	MPV-1/P8	MPV-1/P9	MPV-1/P10	MPV-1/P11	MPV-1/P12		
Little Grebe	小鸊鹈	P		2	2		1		2			1			8	
Great Egret	大白鷺	P								1			2		3	√
Intermediate Egret	中白鷺	M,P						1							1	
Little Egret	小白鷺	P	1	3	4					5	1	4			18	√
Chinese Pond Heron	池鷺	P	3	1	6		2	1		2	2	1	1		19	√
Black Kite	黑鳶(麻鷹)	W,R								1					1	√
White-breasted Waterhen	白胸苦惡鳥	R	1		3										4	√
Spotted Dove	珠頸斑鳩	R		1	3		1	4	3	1	2			2	17	
Common Koel	噪鵑	Su,R													0	√
Barn Swallow	家燕	SpM,Su			3	2	2	1						2	10	
White Wagtail	白鶺鴒	W,R			3						2	2			7	
Red-whiskered Bulbul	紅耳鵯	R		2											2	√
Chinese Bulbul	白頭鵯	R		1	2	1		3	1						8	√
Long-tailed Shrike	棕背伯勞	R		0	1							1			2	
Oriental Magpie Robin	鵲鴝	R	1				2			2					5	
Masked Laughingthrush	黑臉噪鶥	R	1					2							3	
Yellow-bellied Prinia	黃腹山鶯	R	2	2	8		2	1	1			1		2	19	√
Plain Prinia	純色山鶯	R	2	2	1	1	2		2						10	√
Japanese White-eye	暗綠繡眼鳥	R,?W			2										2	√
Eurasian Tree Sparrow	麻雀	R			15		11	38	3						67	√
Black-collared Starling	黑領椋鳥	R			2				1			1			4	
White-shouldered Starling	灰背椋鳥	M,W,Su								4					4	
Common Myna	家八哥	R		1											1	√
Crested Myna	八哥	R	4		3				2			2			11	
Common Magpie	喜鵲	R						1							1	
Collared Crow	白頸鴉	Uncommon											7		7	√
Azure-winged Magpie	灰喜鵲	Category E*				1									1	
No. of Birds at Each Point:			**15**	**15**	**58**	**5**	**23**	**52**	**15**	**16**	**7**	**13**	**10**	**6**		
No. of Birds Recorded from Point Count:			**235**													
No. of Species Recorded from Point Count:			**26**													
Total No. of Species:			**27**													
Total No. of Species of Conservation Interest:			**4**													

Note:
(1) Species in bold represents Species of Conservation Interest.
(2) R=resident; W=winter visitor; Su=summer visitor; M=migrant; A=autumn; Sp=spring; P=present all year
[Principal status was assessed with reference to Carey *et al*. (2001): The Avifauna of Hong Kong]
* Category E: Species for which all published Hong Kong records are considered likely to relate to birds that have escaped or have been released from captivity and do not possess a Principal Status.

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: Access road leading to TPP
Survey Site: TPP-1
Survey Date: 14 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location					Sub-total	Walk Transect
			TPP-1/P1	TPP-1/P2	TPP-1/P3	TPP-1/P4	TPP-1/P5		
Little Egret	小白鷺	P		3				3	
Chinese Pond Heron	池鷺	P	1	5	1			7	√
Chinese Francolin	中華鷓鴣	R						0	√
White-breasted Waterhen	白胸苦惡鳥	R	2	1	1			4	
Green Sandpiper	白腰草鷸	W		1	2			3	
Common Sandpiper	磯鷸	M,W			1			1	
Rock Dove	原鴿	R			2			2	
Spotted Dove	珠頸斑鳩	R	4	5	1	2		12	
Common Koel	噪鵑	Su,R						0	√
Greater Coucal	褐翅鴉鵑	R		1	1			2	
Barn Swallow	家燕	SpM,Su	2	2	1	1		6	√
White Wagtail	白鶺鴒	W,R	1	3	2	1		7	
Red-whiskered Bulbul	紅耳鵯	R	2			2		4	
Chinese Bulbul	白頭鵯	R	5	1		1		7	
Oriental Magpie Robin	鵲鴝	R	1	4	3	1		9	
Yellow-bellied Prinia	黃腹山鶯	R	2	2	7	5	5	21	
Plain Prinia	純色山鶯	R				1		1	
Common Tailorbird	長尾縫葉鶯	R	2			1		3	
Japanese White-eye	暗綠繡眼鳥	R,?W	2					2	
Eurasian Tree Sparrow	麻雀	R	3	4		5	5	17	
Black-collared Starling	黑領椋鳥	R		2				2	
White-shouldered Starling	灰背椋鳥	M,W,Su			1		1	2	
Common Myna	家八哥	R	2					2	
Crested Myna	八哥	R			12	1		13	
No. of Birds at Each Point:			**29**	**34**	**35**	**21**	**11**		
No. of Birds Recorded from Point Count:			**130**						
No. of Species Recorded from Point Count:			**22**						
Total No. of Species:			**24**						
Total No. of Species of Conservation Interest:			**2**						

Note:
(1) Species in bold represents Species of Conservation Interest.
(2) R=resident; W=winter visitor; Su=summer visitor; M=migrant; Sp=spring; P=present all year; ?W=the extent of immigration in winter is unclear
[Principal status was assessed with reference to Carey *et al* . (2001): The Avifauna of Hong Kong]

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: Access road leading to TPP
Survey Site: TPP-2
Survey Date: 14 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location				Sub-total	Walk Transect
			TPP-2/P1	TPP-2/P2	TPP-2/P3	TPP-2/P4		
Little Egret	小白鷺	P					0	√
Little Ringed Plover	金眶鴴(黑領鴴)	W,R	1	1	17		19	
Common Sandpiper	磯鷸	M,W			7		7	
Common Kingfisher	普通翠鳥	AM,P		1			1	
White Wagtail	白鶺鴒	W,R		1	11	2	14	
Red-whiskered Bulbul	紅耳鵯	R		2			2	
Oriental Magpie Robin	鵲鴝	R	2		2		4	
Masked Laughingthrush	黑臉噪鶥	R		2			2	
Scaly-breasted Munia	斑文鳥	R	10	1			11	
Eurasian Tree Sparrow	麻雀	R	1	20	4	1	26	
Black-collared Starling	黑領椋鳥	R		1	1		2	√
Common Myna	家八哥	R	1				1	
Crested Myna	八哥	R	1		4	1	6	
Blue Magpie	紅嘴藍鵲	R			1		1	
No. of Birds at Each Pond:			**16**	**29**	**47**	**3**		
No. of Birds Recorded from Point Count:			**95**					
No. of Species Recorded from Point Count:			**13**					
Total No. of Species:			**14**					
Total No. of Species of Conservation Interest:			**1**					

Note:
(1) Species in bold represents Species of Conservation Interest.
(2) R=resident; W=winter visitor; M=migrant; A=autumn; P=present all year
[Principal status was assessed with reference to Carey *et al*. (2001): The Avifauna of Hong Kong]

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: Access road leading to TPP
Survey Site: TPP-3
Survey Date: 14 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location			Sub-total
			TPP-3/P1	TPP-3/P2	TPP-3/P3	
White-breasted Waterhen	白胸苦惡鳥	R	1			1
Spotted Dove	珠頸斑鳩	R		1		1
Common Koel	噪鵑	Su,R			1	1
Red-whiskered Bulbul	紅耳鵯	R	2	3	9	14
Chinese Bulbul	白頭鵯	R		2	2	4
Oriental Magpie Robin	鵲鴝	R		1	3	4
Masked Laughingthrush	黑臉噪鶥	R	4	2	2	8
Yellow-bellied Prinia	黃腹山鶯鶯	R	5	3		8
Plain Prinia	純色山鶯鶯	R		1		1
Common Tailorbird	長尾縫葉鶯	R	1		1	2
Eurasian Tree Sparrow	麻雀	R			1	1
Black-collared Starling	黑領椋鳥	R	1			1
Crested Myna	八哥	R	1			1
Blue Magpie	紅嘴藍鵲	R			1	1
Common Magpie	喜鵲	R			1	1
No. of Birds at Each Pond:			**14**	**13**	**21**	
No. of Birds Recorded from Point Count:				**48**		
No. of Species Recorded from Point Count:				**15**		
Total No. of Species:				**15**		
Total No. of Species of Conservation Interest:				**0**		

Note:
(2) R=resident; Su=summer visitor
[Principal status was assessed with reference to Carey *et al*. (2001): The Avifauna of Hong Kong]

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: SSS / ERS
Survey Site: SSS-2a
Survey Date: 14 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	SSS-2a/P1	SSS-2a/P3	Sub-total
White-breasted Waterhen	白胸苦惡鳥	R		1	1
Barn Swallow	家燕	SpM,Su	2		2
Red-whiskered Bulbul	紅耳鵯	R	2		2
Chinese Bulbul	白頭鵯	R		2	2
Oriental Magpie Robin	鵲鴝	R	1	3	4
Masked Laughingthrush	黑臉噪鶥	R	4	1	5
Yellow-bellied Prinia	黃腹山鶯	R	1		1
Common Tailorbird	長尾縫葉鶯	R		1	1
Japanese White-eye	暗綠繡眼鳥	R,?W	1	3	4
Eurasian Tree Sparrow	麻雀	R	3		3
Black-collared Starling	黑領椋鳥	R	2		2
No. of Birds at Each Point:			**16**	**10**	
No. of Birds Recorded from Point Count:			**26**		
No. of Species Recorded from Point Count:			**11**		
Total No. of Species:			**11**		
Total No. of Species of Conservation Interest:			**0**		

Note:

(2) R=resident; Su=summer visitor; M=migrant; Sp=Spring visitor; ?W=the extent of immigration in winter is unclear
[Principal status was assessed with reference to Carey *et al*. (2001): The Avifauna of Hong Kong]

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: SSS / ERS
Survey Site: SSS-3
Survey Date: 14 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location												Sub-total	Walk Transect
			SSS-3/P1	SSS-3/P2	SSS-3/P3	SSS-3/P4	SSS-3/P5	SSS-3/P6	SSS-3/P7	SSS-3/P8	SSS-3/P9	SSS-3/P10	SSS-3/P11	SSS-3/P12		
Little Egret	小白鷺	P							1			1	1		3	
Chinese Pond Heron	池鷺	P						1	1			4	1		7	√
Black Kite	黑鳶(麻鷹)	W,R													0	√
White-breasted Waterhen	白胸苦惡鳥	R	1											1	2	
Spotted Dove	珠頸斑鳩	R	2		1						1		6		10	√
Plaintive Cuckoo	八聲杜鵑	Su										1			1	
Common Koel	噪鵑	Su,R							2						2	√
Greater Coucal	褐翅鴉鵑	R							1					1	2	
White-throated Kingfisher	白胸翡翠	AM,P											1		1	
Barn Swallow	家燕	SpM,Su											2		2	√
White Wagtail	白鶺鴒	W,R			1		2	1						1	5	√
Red-whiskered Bulbul	紅耳鵯	R	5	5		4	2		4		2		1		23	√
Chinese Bulbul	白頭鵯	R							2						2	
Long-tailed Shrike	棕背伯勞	R										1			1	
Oriental Magpie Robin	鵲鴝	R				1		1			1				3	√
Masked Laughingthrush	黑臉噪鸦	R		5		3				6				3	17	
Yellow-bellied Prinia	黃腹山鶯鶯	R			1			2	1		1		1		6	√
Plain Prinia	純色山鶯鶯	R												1	1	
Common Tailorbird	長尾縫葉鶯	R							1		1			1	3	
Dusky Warbler	褐柳鶯	W													0	√
Great Tit	大山雀	R											2		2	
Japanese White-eye	暗綠繡眼鳥	R,?W			1						1		1		3	√
Scaly-breasted Munia	斑文鳥	R			1	3			3				4		11	
Eurasian Tree Sparrow	麻雀	R				5		12							17	√
Black-collared Starling	黑領椋鳥	R				2		1			1			10	14	√
White-shouldered Starling	灰背椋鳥	M,W,Su						1		2		2	4		9	
Crested Myna	八哥	R							2			16	10	10	38	√
No. of Birds at Each Point:			**8**	**10**	**5**	**18**	**4**	**19**	**18**	**8**	**8**	**25**	**34**	**28**		
No. of Birds Recorded from Point Count:			**185**													
No. of Species Recorded from Point Count:			**25**													
Total No. of Species:			**27**													
Total No. of Species of Conservation Interest:			**3**													

Note:
(1) Species in bold represents Species of Conservation Interest.
(2) R=resident; W=winter visitor; Su=summer visitor; M=migrant; Sp=spring; P=present all year; ?W=the extent of immigration in winter is unclear
[Principal status was assessed with reference to Carey *et al* . (2001): The Avifauna of Hong Kong]

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: TUW
Survey Site: TUW-1
Survey Date: 21 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location							Sub-total	Walk Transect
			TUW-1/P1	TUW-1/P2	TUW-1/P3	TUW-1/P4	TUW-1/P5	TUW-1/P6	TUW-1/P7		
Little Egret	小白鷺	P				1		1		2	
Chinese Pond Heron	池鷺	P	1	3	1	4		2		11	√
White-breasted Waterhen	白胸苦惡鳥	R		2			1	1	1	5	
Green Sandpiper	白腰草鷸	W		2						2	
Common Sandpiper	磯鷸	M,W		1				2		3	
Spotted Dove	珠頸斑鳩	R	1	2	1	2	1	6	4	17	√
Common Koel	噪鵑	Su,R				1			1	2	
Greater Coucal	褐翅鴉鵑	R							1	1	
Barn Swallow	家燕	SpM,Su		1	2					3	
White Wagtail	白鶺鴒	W,R		3				2		5	
Red-whiskered Bulbul	紅耳鵯	R	2	8	1	4	13		2	30	√
Chinese Bulbul	白頭鵯	R		4	5	3				12	√
Long-tailed Shrike	棕背伯勞	R		1						1	√
Oriental Magpie Robin	鵲鴝	R	1	4	2	2		2		11	
Masked Laughingthrush	黑臉噪鶥	R	2					3		5	√
Yellow-bellied Prinia	黃腹山鶯鶯	R	1	3	1	4	1	5	3	18	√
Plain Prinia	純色山鶯鶯	R				1	1		2	4	
Great Tit	大山雀	R								0	√
Japanese White-eye	暗綠繡眼鳥	R,?W				3	3			6	
Scaly-breasted Munia	斑文鳥	R	11	4		3				18	
Eurasian Tree Sparrow	麻雀	R			8				2	10	√
Black-collared Starling	黑領椋鳥	R		2					3	5	
White-shouldered Starling	灰背椋鳥	M,W,Su		1					2	3	
Common Myna	家八哥	R								0	√
Crested Myna	八哥	R	6	1	1				2	10	√
Large-billed Crow	大嘴烏鴉	R								0	√
No. of Birds at Each Point:			**25**	**42**	**22**	**28**	**20**	**24**	**23**		
No. of Birds Recorded from Point Count:			**184**								
No. of Species Recorded from Point Count:			**23**								
Total No. of Species:			**26**								
Total No. of Species of Conservation Interest:			**3**								

Note:
(1) Species in bold represents Species of Conservation Interest.
(2) R=resident; W=winter visitor; Su=summer visitor; M=migrant; Sp=spring; P=present all year; ?W=the extent of immigration in winter is unclear
[Principal status was assessed with reference to Carey *et al*. (2001): The Avifauna of Hong Kong]

Appendix G Bird Species and Abundance Recorded during the Avifauna Monitoring in July 2011

Works Area: TUW and PHV
Survey Site: TUW-2 and PHV-1 (grouped together due to overlapping of survey area)
Survey Date: 21 July 2011

Common Name [1]	Chinese Name	Principal Status [2]	Point Count Location		Sub-total	Walk Transect
			TUW-2 and PHV-1/P1	TUW-2 and PHV-1/P2		
Black Kite	黑鳶(麻鷹)	W,R			0	√
Crested Serpent Eagle	蛇鵰	R,M			0	√
Spotted Dove	珠頸斑鳩	R			0	√
Asian Koel	噪鵑	Su,R			0	√
Plaintive Cuckoo	八聲杜鵑	Su	1		1	
Red-whiskered Bulbul	紅耳鵯	R		5	5	√
Chinese Bulbul	白頭鵯	R	3		3	
Grey-chinned Minivet	灰喉山椒鳥	R,W	1		1	√
Scarlet Minivet	赤紅山椒鳥	R	1		1	√
Oriental Magpie Robin	鵲鴝	R	1		1	√
Blue Whistling Thrush	紫嘯鶇	R			0	√
Streak-breasted Scimitar Babbler	棕頸鉤嘴鹛	R			0	√
Masked Laughingthrush	黑臉噪鹛	R			0	√
Dusky Warbler	褐柳鶯	W		1	1	
Yellow-bellied Prinia	黃腹山鷦鶯	R			0	√
Common Tailorbird	長尾縫葉鶯	R			0	√
Chinese Hwamei	畫眉	R	1		1	√
Scarlet-backed Flowerpecker	朱背啄花鳥	R	1		1	√
Fork-tailed Sunbird	叉尾太陽鳥	R			0	√
Japanese White-eye	暗綠繡眼鳥	R,?W			0	√
No. of Birds at Each Point:			**9**	**6**		
No. of Birds Recorded from Point Count:			**15**			
No. of Species Recorded from Point Count:			**9**			
Total No. of Species:			**20**			
Total No. of Species of Conservation Interest:			**1**			

Note:
(1) Species in bold represents Species of Conservation Interest.
(2) R=resident; W=winter visitor; Su=summer visitor; M=migrant; ?W=the extent of immigration in winter is unclear
[Principal status was assessed with reference to Carey *et al*. (2001): The Avifauna of Hong Kong]

Appendix H

Representative Photographs of the Avifauna Monitoring

Appendix H Representative Photographs taken during the Avifauna Monitoring in July 2011



Plate 1 Pond Aeration at Point Count Location MPV-1/P8



Plate 2 Little Grebe at Point Count Location MPV-1/P10



Plate 3 Intermediate Egret at Point Count Location MPV-1/P8

Appendix H Representative Photographs taken during the Avifauna Monitoring in July 2011



Plate 4 Chinese Pond Heron at Point Count Location MPV-1/P10



Plate 5 White-shouldered Starling Nest at Point Count Location SSS-3/P11

Appendix I

Certified Arborist Inspection Record

MTR Express Rail Link, Contract 801

Monthly Audit Inspection Record

July 2011

Audit of tree works, including tree protection, pruning work, transplanting work, maintenance works in the temporary holding nursery, and compensation tree planting

Date	Contract	Activity Description	Purpose
27/07/2011 26/07/2011 29/07/2011	801 – Siu Lang Shui (Nursery) So Kwun Wat Nursery CLP private plot in Tai Po Kau	Inspection of trees to be transplanted within the contract	Regular audit of tree works
27/07/2011	802 - Nam Cheong Property Parcel 40.2, and Sham Mong Rd Footpath, Private Lot NKIL6436	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
25/07/2011	810B Parcels 45.1, 45.3, 45.6, 45.7	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
27/07/2011	805 - Sham Mong Road Parcel 41.4,38.3, Sham Mong Road Footpath (near 38.3), and Footpath of Sham Mong Rd, Parcels 38.6/38.7 (footpath alongside CLP Building) NKIL 6363 (CLP Building)	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
25/07/2011	811A—WKT station North Ngo Cheung Road, Hoi Wang Road, Lin Cheung Road	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
25/07/2011	811B - WKT Approach Tunnels – South Parcel 44.1, Lin Cheung Road, and Jordan Road Footpath & Central Divider	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
27/07/2011	820 - Mei Lai Road to Hoi Ting Road Tunnels Parcel 37.2, 37.3, Kwai Chung Road (Footpath near	Inspection of retained trees and trees to be	Regular audit of tree works

	37.5) Sham Mong Road & Hing Wah Street West Footpath Parcel 39.1, 40.4, Sham Mong Road (Nam Cheong Park) Private Lot STT-KX2382, Private Lot STT-KX2416	transplanted within the contract	
26/07/2011	821—Shek Yam to Mei Lai Road Tunnels Parcel NT-9 (slope) NT-10	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
26/07/2011 28/07/2011 26/07/2011	822 - Tse Uk Tsuen to Shek Yam Tunnels Parcels NT-6 (Pat Heung), NT-7, and NT-8, Site Office - San Kwai Street, Kwai Hing, Parcel NT-17 (6.6, 6.9) 822—Siu Lam FW Service Reservoir	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
28/07/2011	823A - Kam Tin Tunnels Parcels NT-5A, NT-5.1A, and NT-5.3A	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
28/07/2011	823B - SSS and ERS Parcels NT-5.1B, NT-5.2, and NT-5.3B	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
25/07/2011 (NTM) 28/07/2011 (TKP)	824 Ngau Tam Mei to Tai Kong Po Tunnels NT-3, NT-5.1A, NT-4	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works
25/07/2011	825 - Mai Po to Ngau Tam Mei Tunnels Parcels NT-1a (Mai Po), CP-12, and verges of Castle Peak Road - Mai Po	Inspection of retained trees and trees to be transplanted within the contract	Regular audit of tree works

Signed by:
Matthew PRYOR (RLA, CA)



Appendix J

Vibration Monitoring Record at

Cheung Yuen (LET-06)

Event Report


Histogram Start Time	13:55:12 July 5, 2011
Histogram Finish Time	14:00:11 July 5, 2011
Number of Intervals	59 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR1
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.1 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	R838DU0U.O00

Extended Notes

	Tran	Vert	Long	
PPV	0.111	0.127	0.111	mm/s
ZC Freq	14	57	12	Hz
Date	Jul 5 /11	Jul 5 /11	Jul 5 /11	
Time	14:00:02	13:59:52	13:56:12	
Sensor Check	Passed	Passed	Passed	
Frequency	7.5	7.5	7.5	Hz
Overswing Ratio	3.7	3.4	4.1	

Peak Vector Sum 0.135 mm/s on July 5, 2011 at 13:56:27

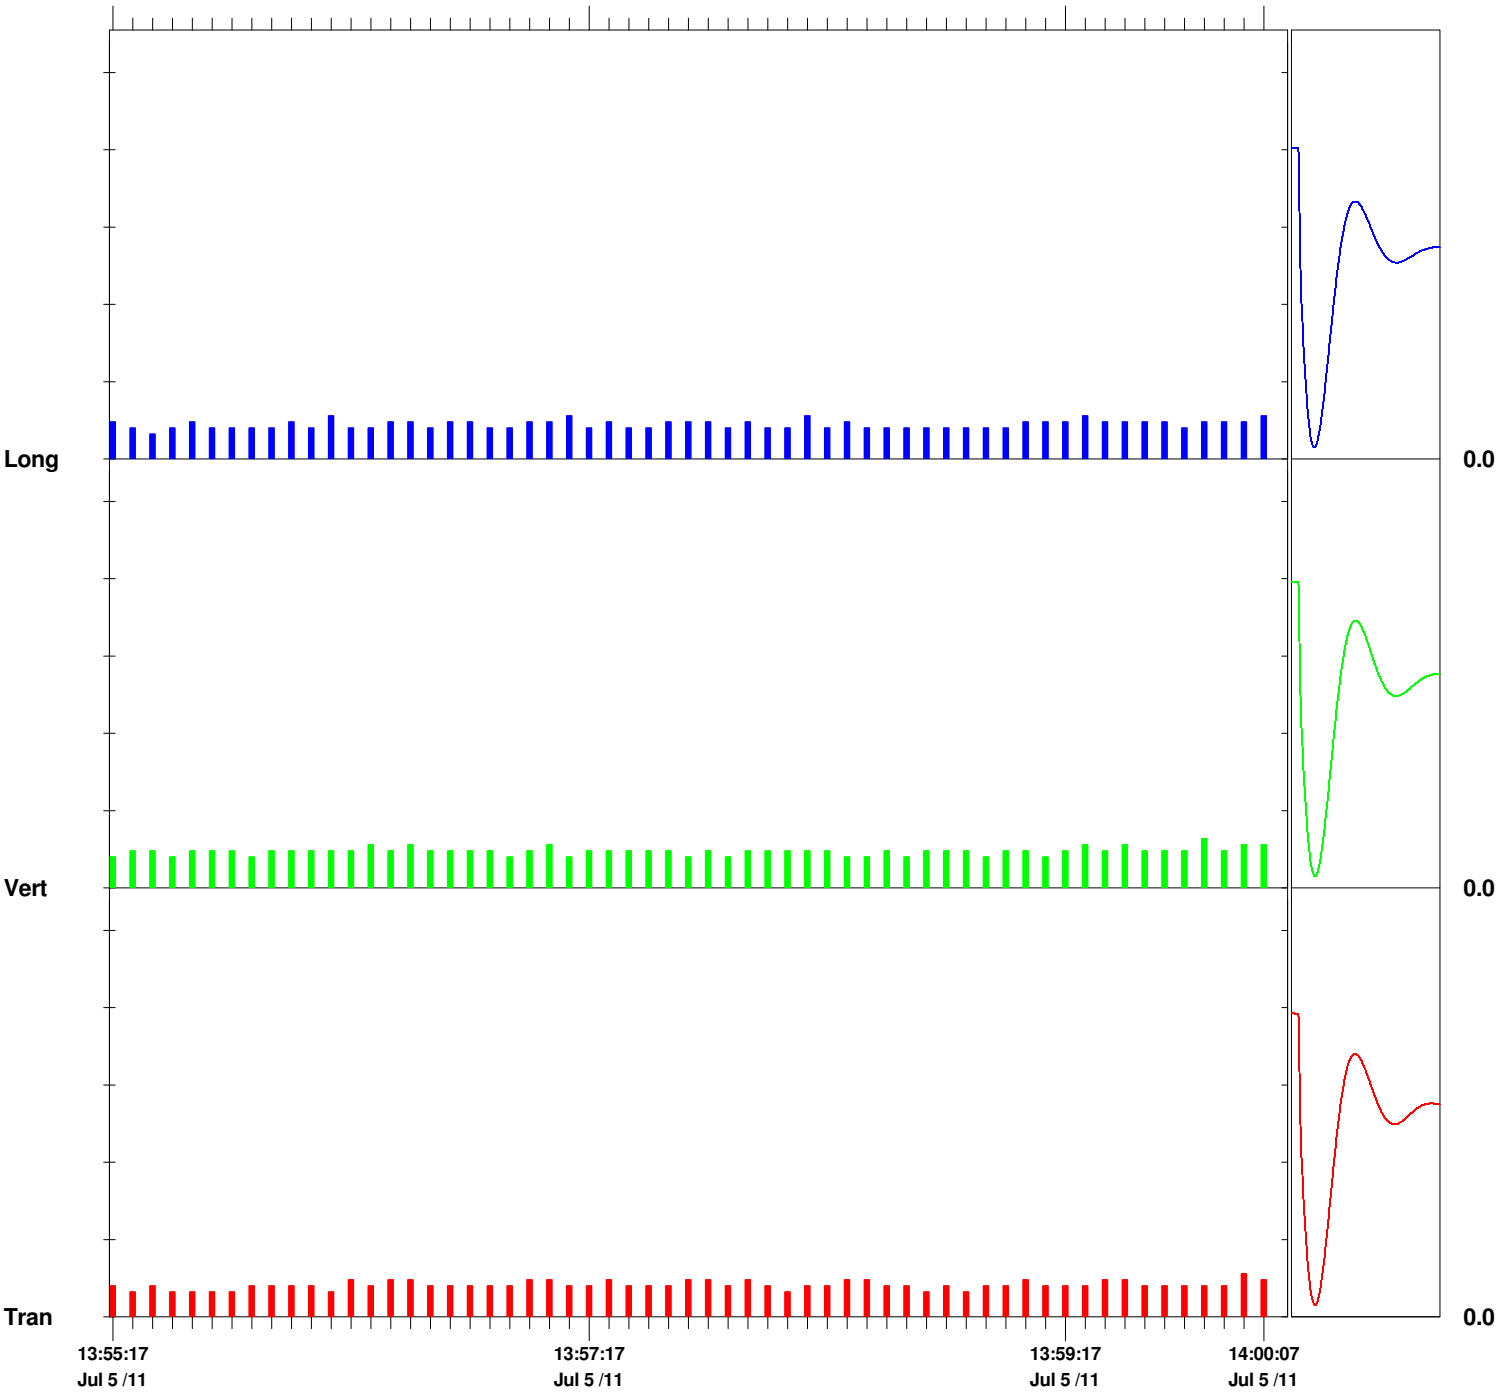

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report


Histogram Start Time	14:26:27 July 11, 2011
Histogram Finish Time	14:32:04 July 11, 2011
Number of Intervals	67 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR1
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.3 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	R838DUC0.430

Extended Notes

	Tran	Vert	Long	
PPV	0.206	0.667	0.556	mm/s
ZC Freq	4.3	14	3.7	Hz
Date	Jul 11 /11	Jul 11 /11	Jul 11 /11	
Time	14:26:42	14:26:42	14:26:42	
Sensor Check	Passed	Passed	Passed	
Frequency	7.3	7.5	7.5	Hz
Overswing Ratio	3.8	3.4	4.1	

Peak Vector Sum 0.839 mm/s on July 11, 2011 at 14:26:42

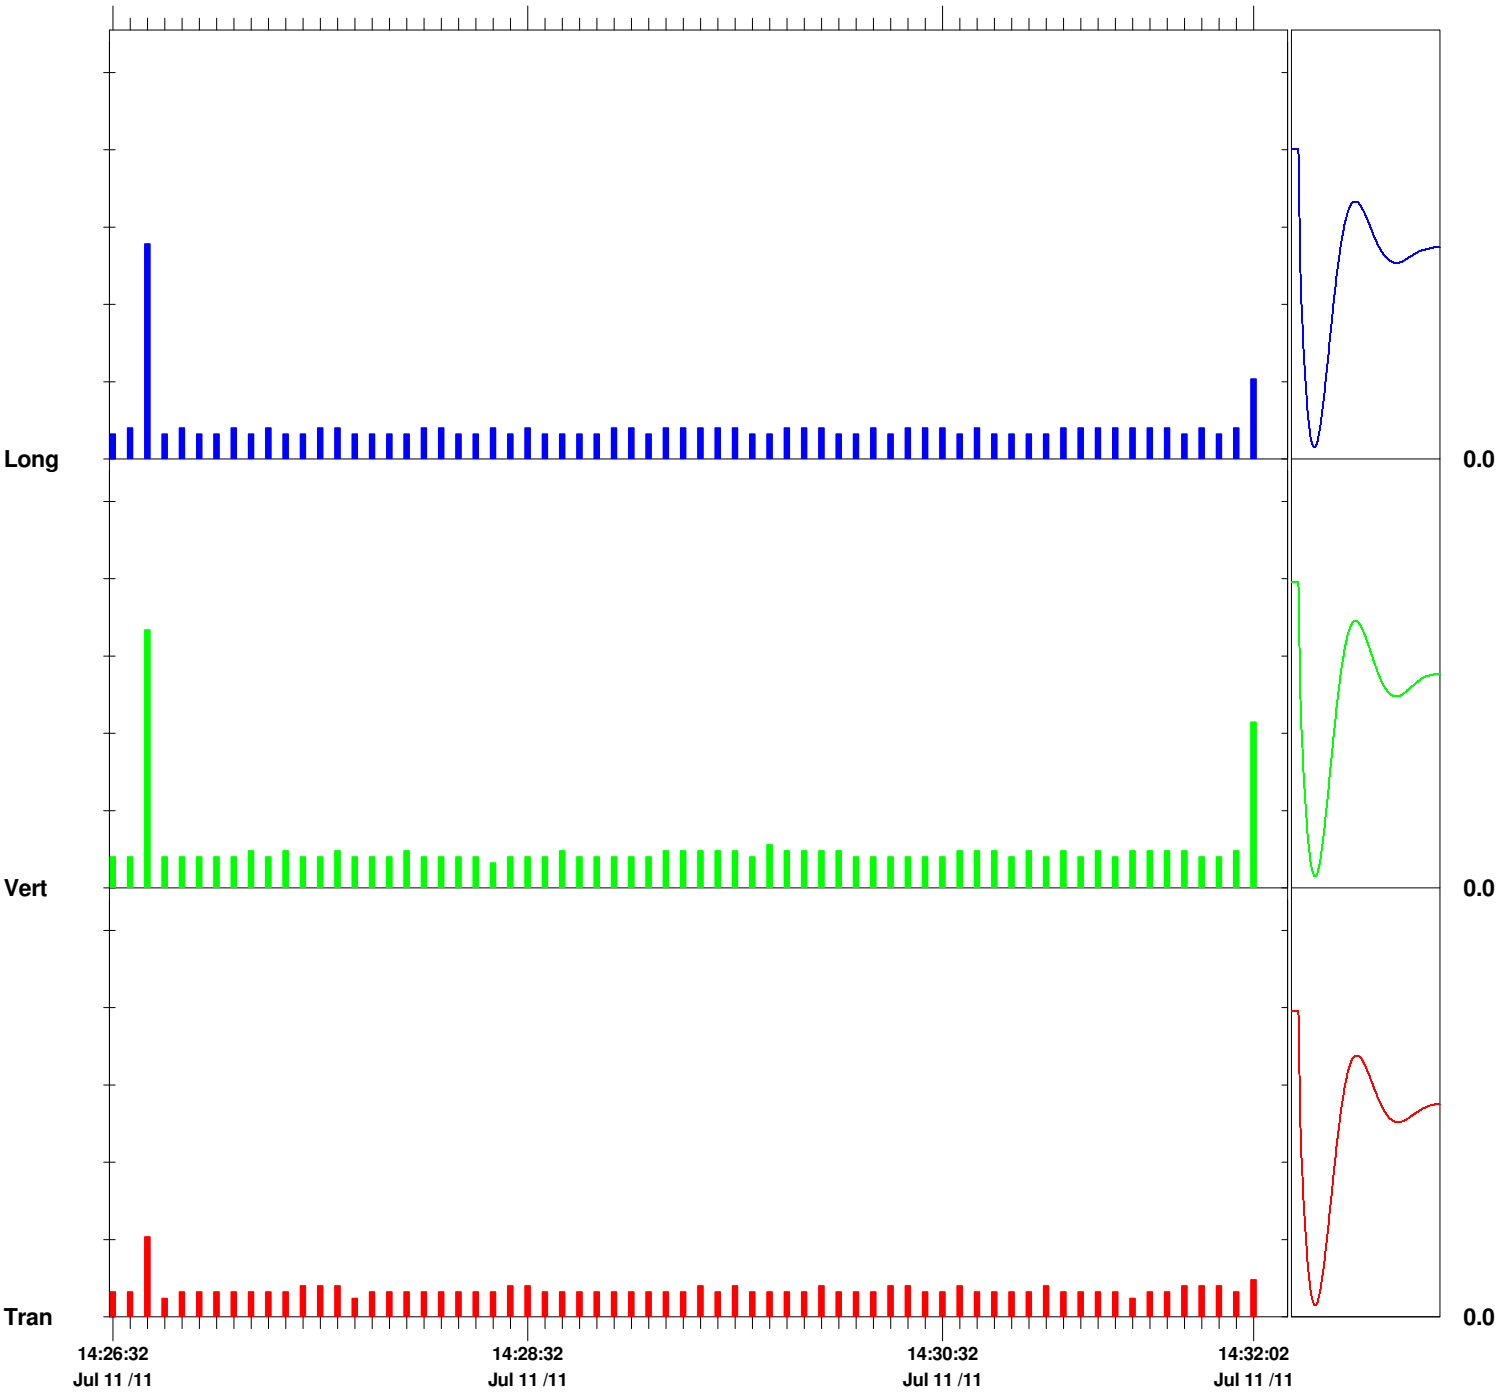

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report


Histogram Start Time	15:16:16 July 19, 2011
Histogram Finish Time	15:21:13 July 19, 2011
Number of Intervals	59 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR1
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.1 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	R838DUQV.R40

Extended Notes

	Tran	Vert	Long	
PPV	0.0794	0.0952	0.0794	mm/s
ZC Freq	64	8.7	11	Hz
Date	Jul 19 /11	Jul 19 /11	Jul 19 /11	
Time	15:18:11	15:16:21	15:16:21	
Sensor Check	Passed	Passed	Passed	
Frequency	8.8	7.5	7.6	Hz
Overswing Ratio	4.2	3.4	4.0	

Peak Vector Sum 0.111 mm/s on July 19, 2011 at 15:20:21

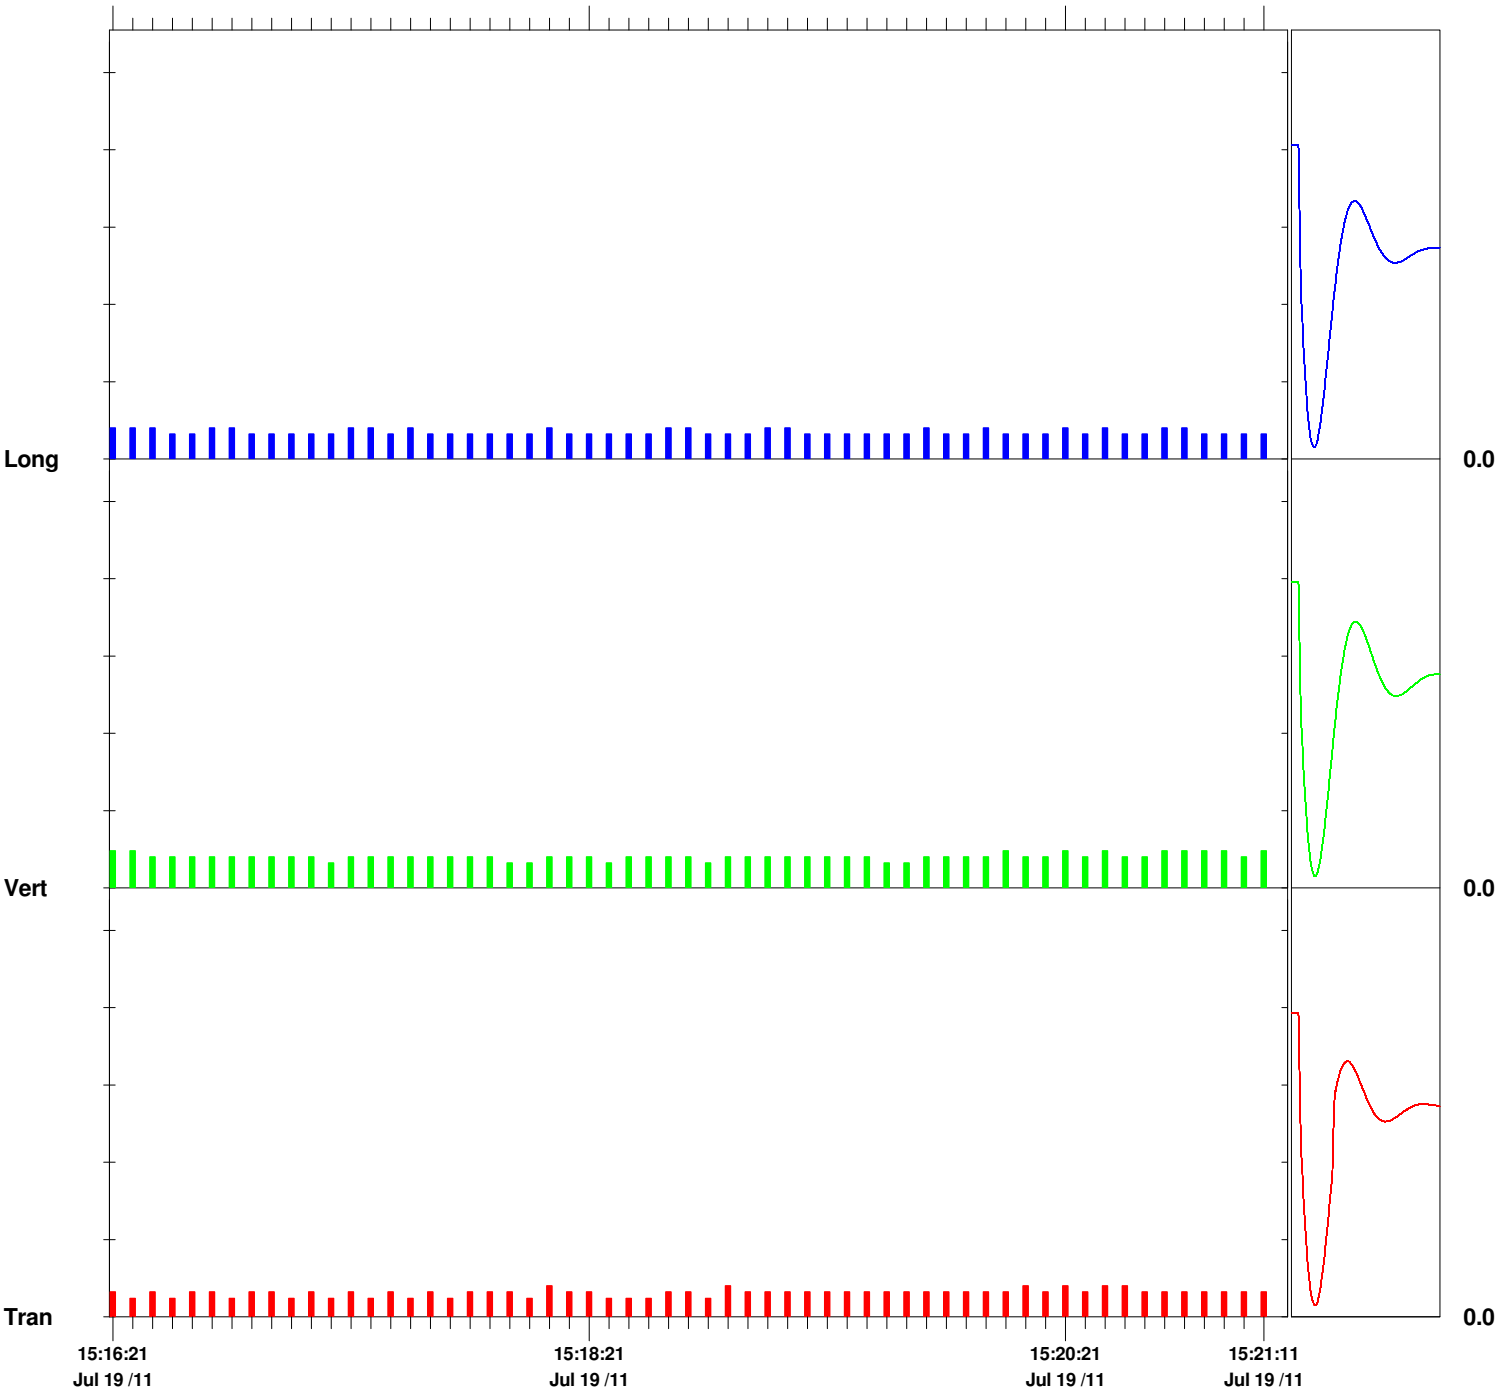

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report

VIBR1


Histogram Start Time	08:55:58 July 28, 2011
Histogram Finish Time	09:01:24 July 28, 2011
Number of Intervals	65 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR1
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.2 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	__TEMP.EVT

Extended Notes

	Tran	Vert	Long	
PPV	0.159	0.238	0.206	mm/s
ZC Freq	7.5	6.9	34	Hz
Date	Jul 28 /11	Jul 28 /11	Jul 28 /11	
Time	08:57:58	08:57:58	08:56:13	
Sensor Check	Passed	Passed	Passed	
Frequency	7.6	7.6	7.8	Hz
Overswing Ratio	3.7	3.4	3.9	

Peak Vector Sum 0.247 mm/s on July 28, 2011 at 08:57:58

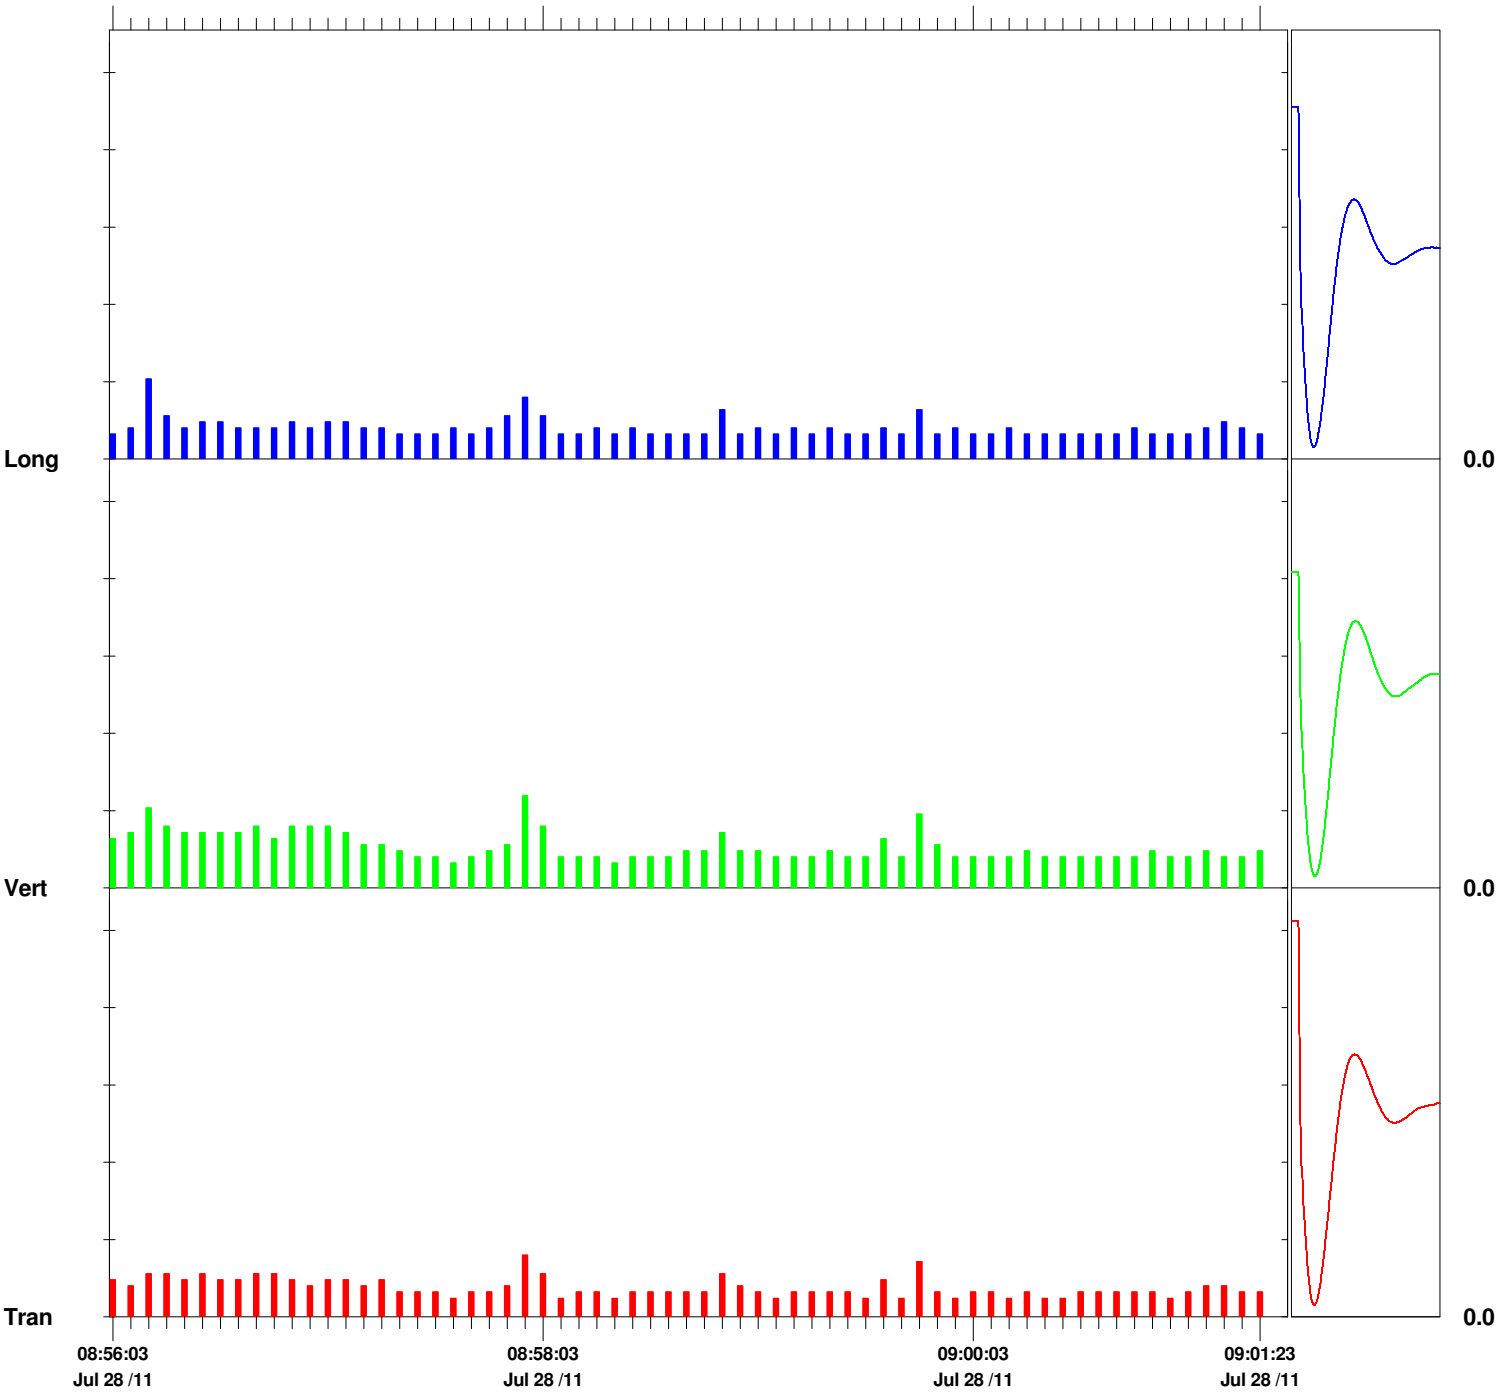

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div

Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report


Histogram Start Time	14:00:59 July 5, 2011
Histogram Finish Time	14:06:34 July 5, 2011
Number of Intervals	66 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR2
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.1 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	R838DU0U.XN0

Extended Notes

	Tran	Vert	Long	
PPV	0.127	0.143	0.0952	mm/s
ZC Freq	34	4.8	19	Hz
Date	Jul 5 /11	Jul 5 /11	Jul 5 /11	
Time	14:05:34	14:06:09	14:01:19	
Sensor Check	Passed	Passed	Passed	
Frequency	7.5	7.5	7.5	Hz
Overswing Ratio	3.6	3.4	4.0	

Peak Vector Sum 0.154 mm/s on July 5, 2011 at 14:06:09

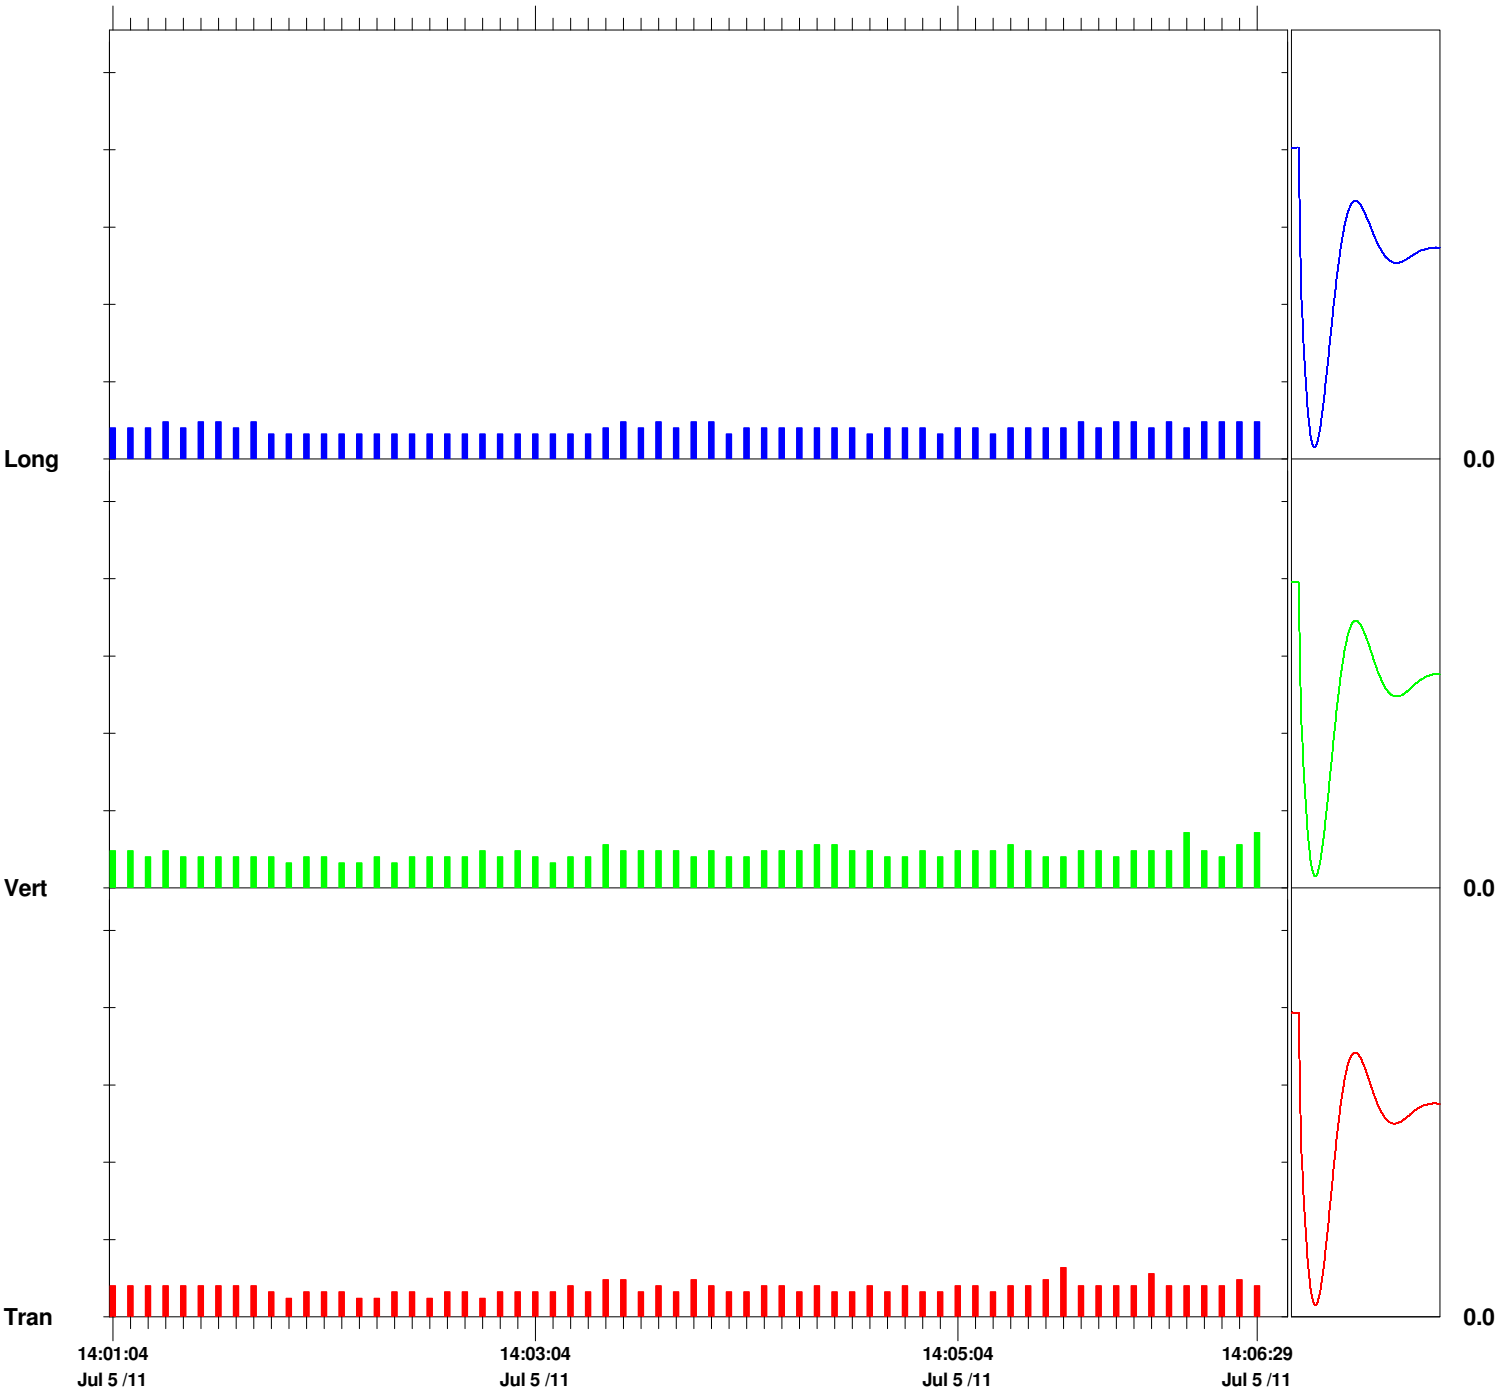

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report


Histogram Start Time	14:33:17 July 11, 2011
Histogram Finish Time	14:38:05 July 11, 2011
Number of Intervals	57 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR2
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.3 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	R838DUC0.FH0

Extended Notes

	Tran	Vert	Long	
PPV	0.111	0.190	0.0794	mm/s
ZC Freq	>100	64	30	Hz
Date	Jul 11 /11	Jul 11 /11	Jul 11 /11	
Time	14:37:17	14:37:17	14:33:37	
Sensor Check	Passed	Passed	Passed	
Frequency	7.3	7.6	7.5	Hz
Overswing Ratio	3.7	3.4	4.0	

Peak Vector Sum 0.212 mm/s on July 11, 2011 at 14:37:17

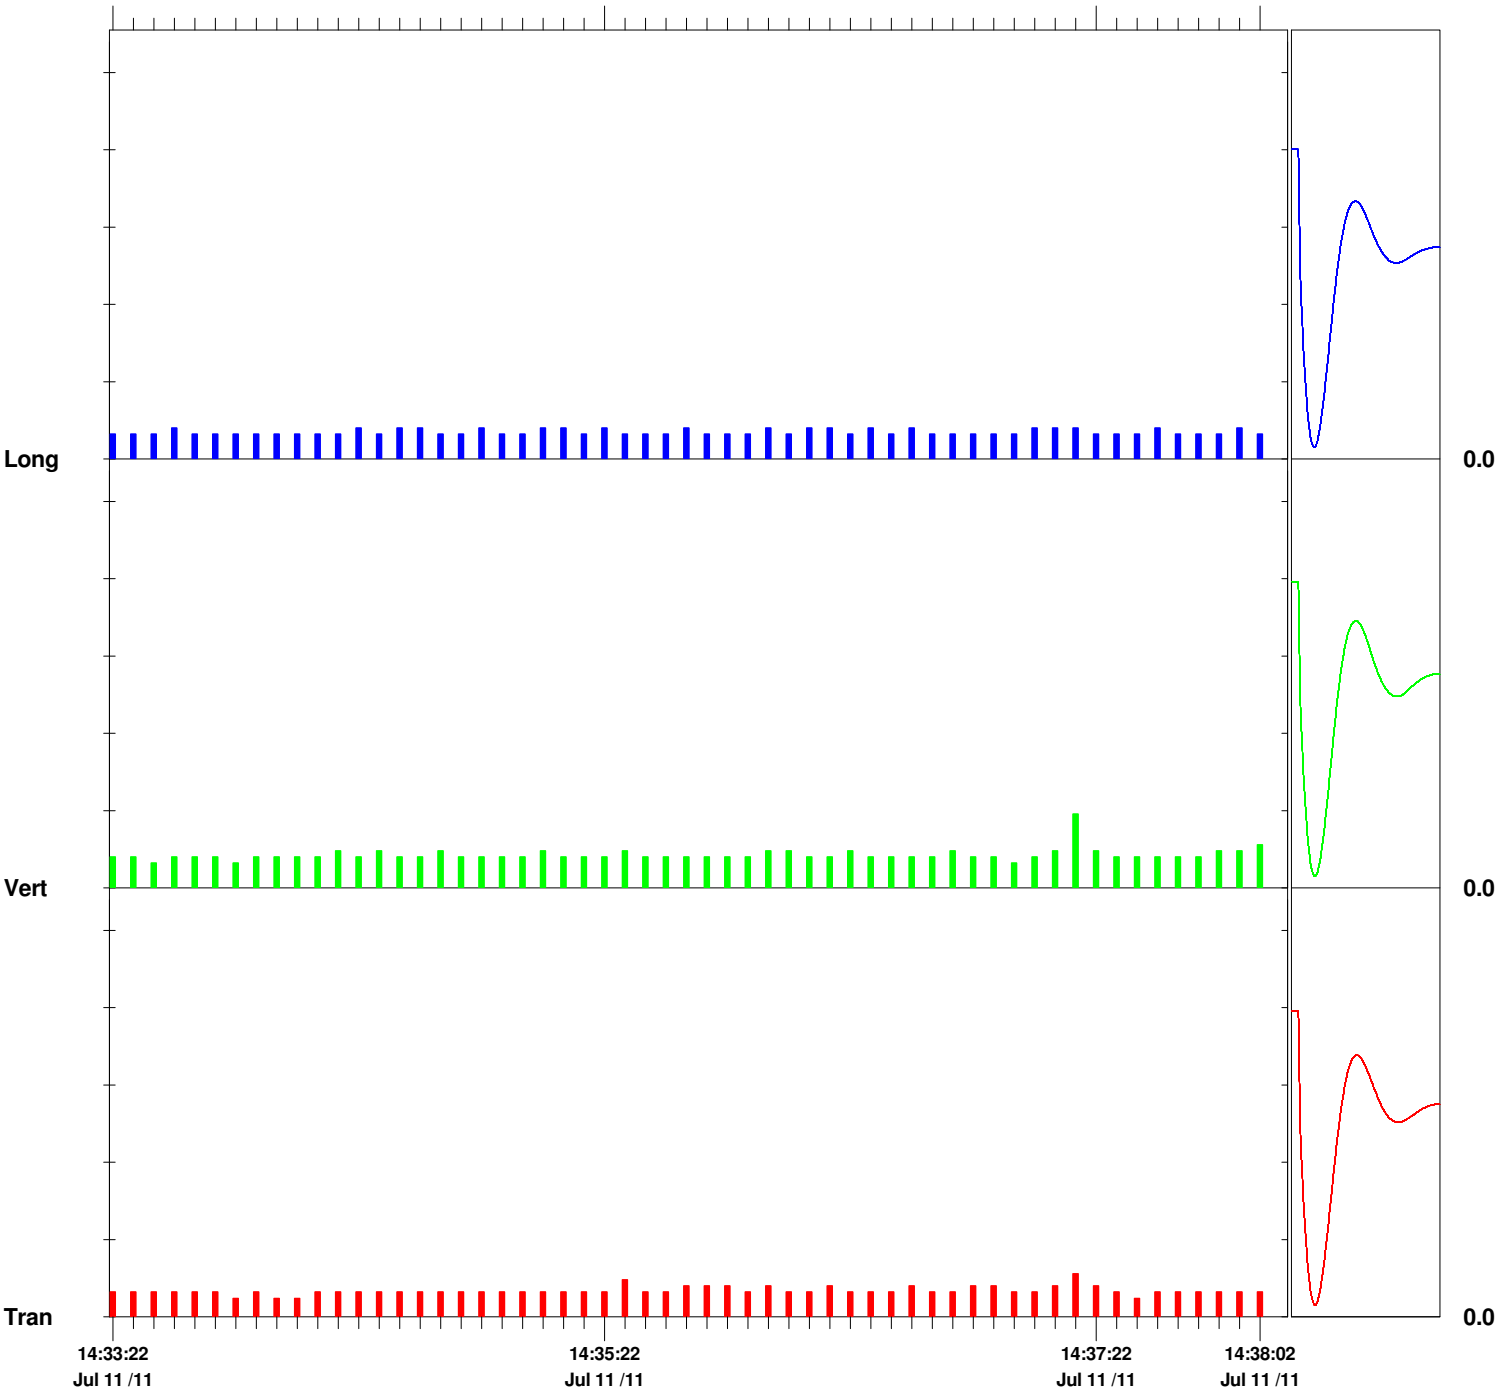

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report


Histogram Start Time	15:22:25 July 19, 2011
Histogram Finish Time	15:28:05 July 19, 2011
Number of Intervals	67 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR2
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.1 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	R838DUQW.1D0

Extended Notes

	Tran	Vert	Long	
PPV	0.175	0.651	0.317	mm/s
ZC Freq	24	9.8	73	Hz
Date	Jul 19 /11	Jul 19 /11	Jul 19 /11	
Time	15:23:05	15:23:15	15:28:00	
Sensor Check	Passed	Passed	Passed	
Frequency	7.3	7.5	7.4	Hz
Overswing Ratio	3.7	3.4	4.0	

Peak Vector Sum 0.658 mm/s on July 19, 2011 at 15:23:15

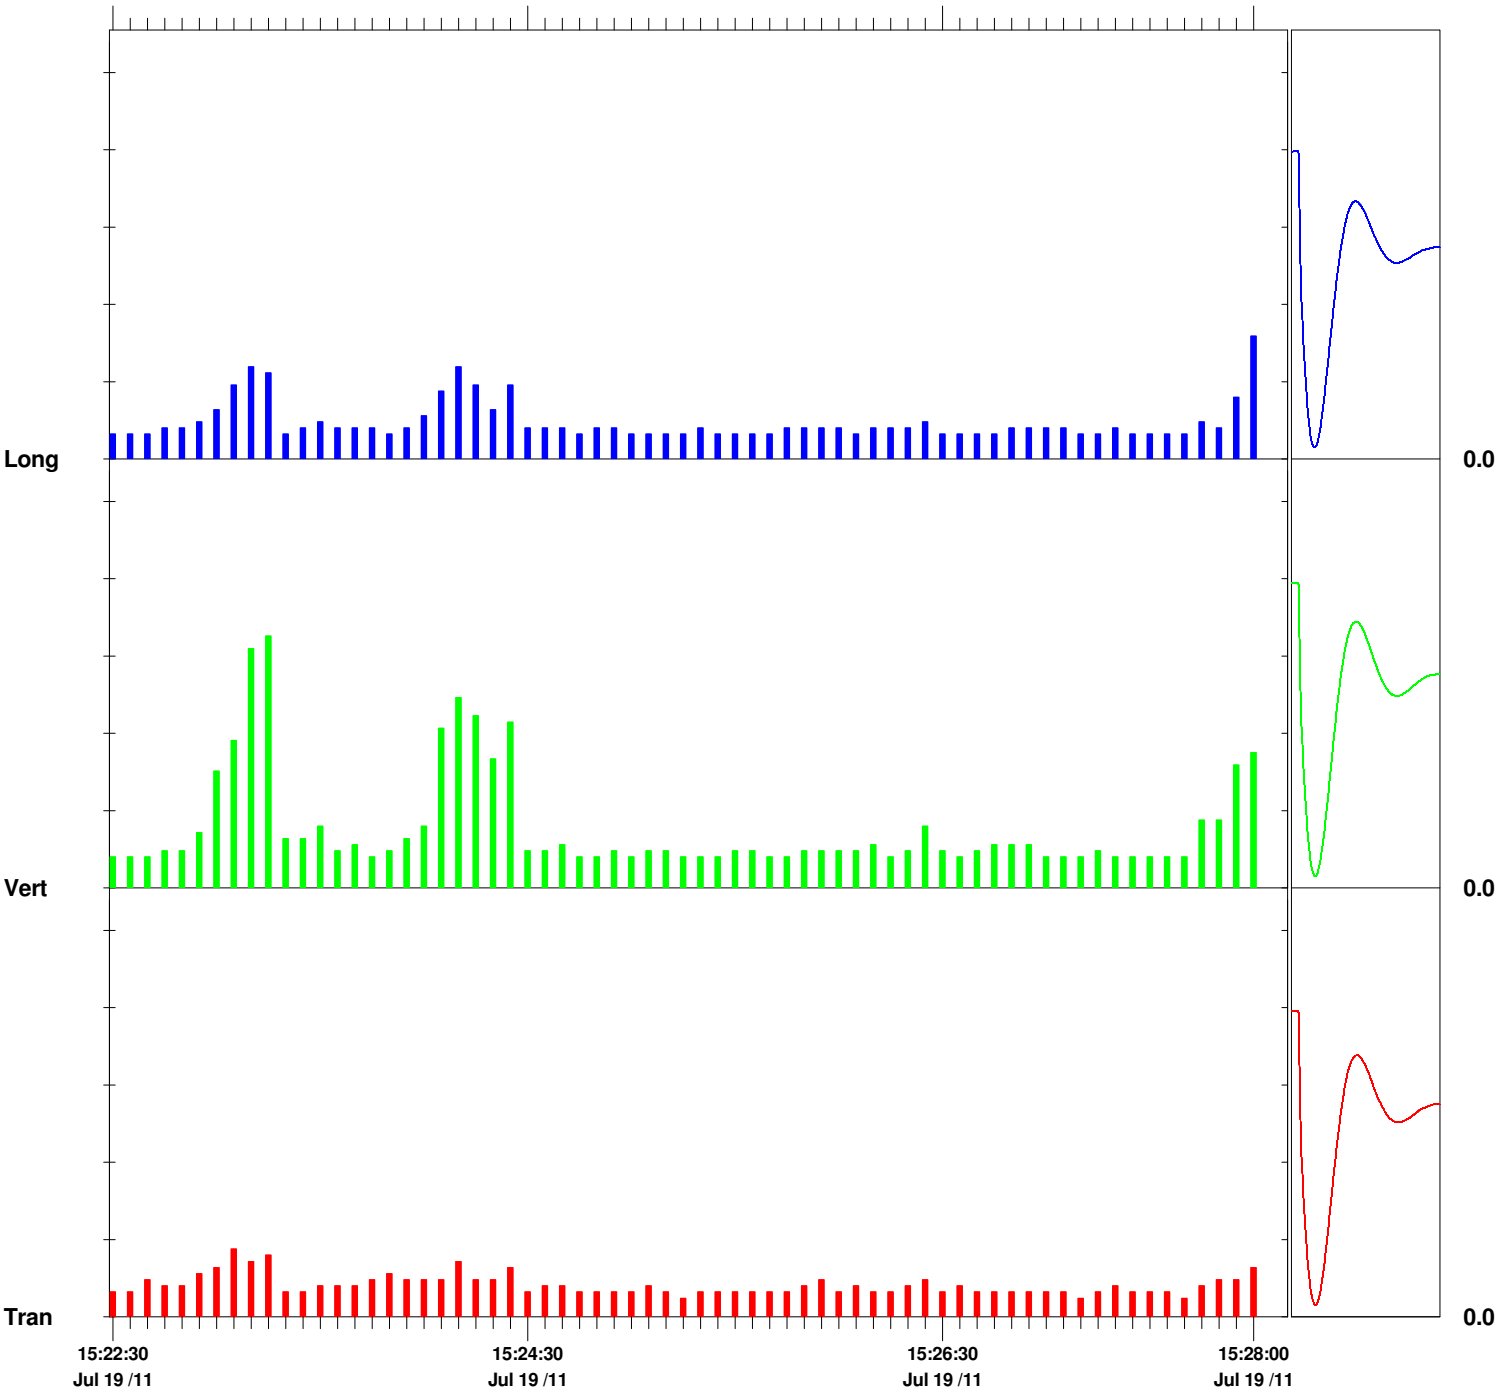

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div Sensor Check

Format © 1995-2011 Xmark Corporation

Event Report

VIBR2


Histogram Start Time	09:03:16 July 28, 2011
Histogram Finish Time	09:08:53 July 28, 2011
Number of Intervals	67 at 5 seconds
Range	Geo:31.7 mm/s
Sample Rate	1024sps
Job Number:	1
Notes	
Location:	Cheung Yuen - VIBR2
Client:	823B
User Name:	
General:	

Serial Number	BE16838 V 10.10-8.17 MiniMate Plus
Battery Level	6.2 Volts
Unit Calibration	March 15, 2011 by Instantel inc.
File Name	__TEMP.EVT

Extended Notes

	Tran	Vert	Long	
PPV	0.222	0.333	0.175	mm/s
ZC Freq	6.8	12	8.1	Hz
Date	Jul 28 /11	Jul 28 /11	Jul 28 /11	
Time	09:03:56	09:03:56	09:03:56	
Sensor Check	Passed	Passed	Passed	
Frequency	7.6	7.6	7.5	Hz
Overswing Ratio	3.6	3.4	4.1	


Peak Vector Sum 0.357 mm/s on July 28, 2011 at 09:03:56

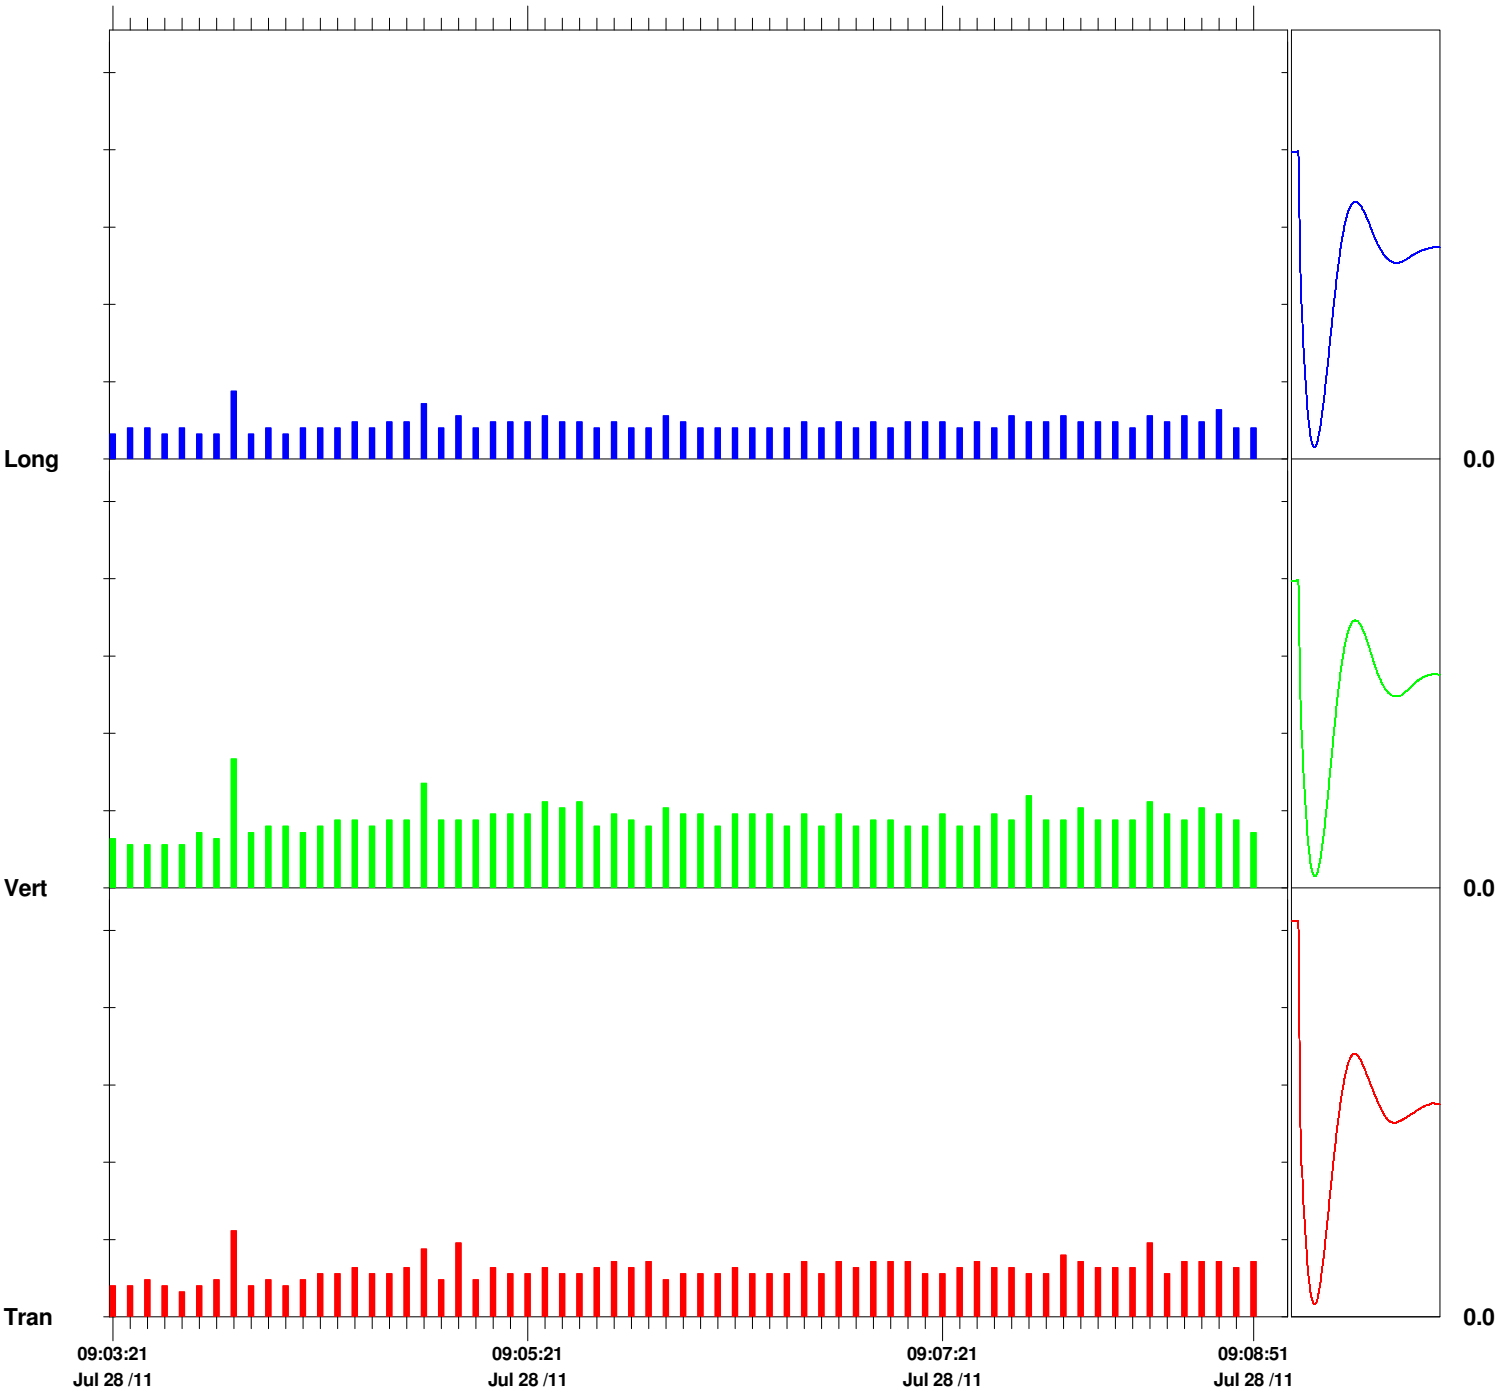

Time Scale: 5 seconds /div **Amplitude Scale:** Geo: 0.200 mm/s/div

Sensor Check

Format © 1995-2011 Xmark Corporation

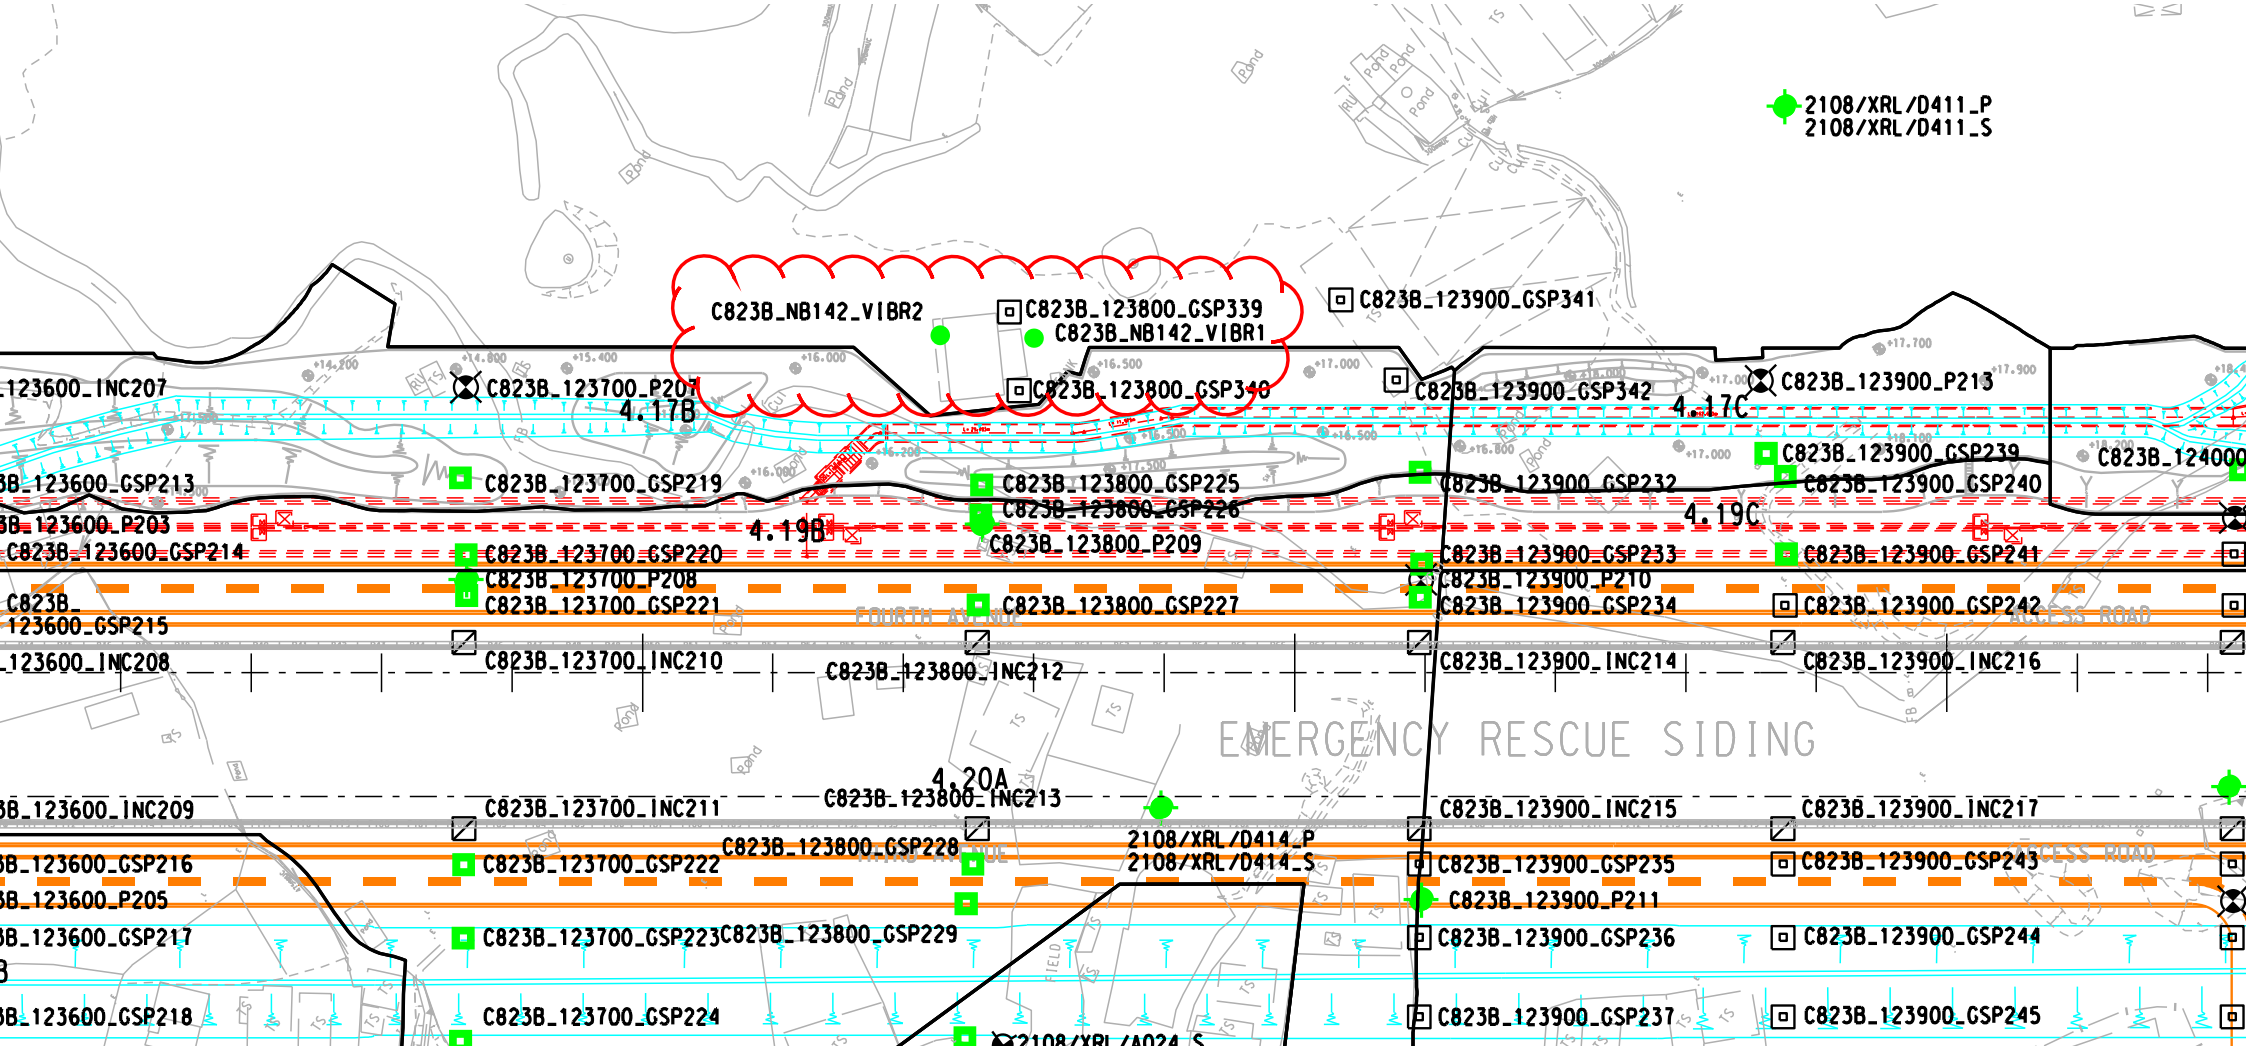
2108/XRL/D411_P
2108/XRL/D411_S
C823B_NB142_VIBR2
C823B_123800_GSP339
C823B_NB142_VIBR1
C823B_123900_GSP341
C823B_123800_GSP340
C823B_123900_GSP342
C823B_123700_P207
4.17B
4.17C
C823B_123900_P213
C823B_123900_GSP239
C823B_124000
C823B_123700_GSP219
C823B_123800_GSP225
C823B_123800_GSP226
C823B_123900_GSP232
C823B_123900_GSP240
4.19B
4.19C
C823B_123800_P209
C823B_123600_GSP214
C823B_123700_GSP220
C823B_123900_GSP233
C823B_123900_GSP241
C823B_123700_P208
C823B_123900_P210
C823B_123700_GSP221
C823B_123800_GSP227
C823B_123900_GSP234
C823B_123900_GSP242
C823B_123600_GSP215
FOURTH AVENUE
ACCESS ROAD
C823B_123700_INC210
C823B_123800_INC212
C823B_123900_INC214
C823B_123900_INC216
EMERGENCY RESCUE SIDING
4.20A
C823B_123800_INC213
C823B_123700_INC211
C823B_123900_INC215
C823B_123900_INC217
C823B_123800_GSP228
2108/XRL/D414_P
2108/XRL/D414_S
C823B_123700_GSP222
C823B_123900_GSP235
C823B_123900_GSP243
C823B_123900_P211
C823B_123700_GSP223
C823B_123800_GSP229
C823B_123900_GSP236
C823B_123900_GSP244
C823B_123700_GSP224
C823B_123900_GSP237
C823B_123900_GSP245

Appendix K

IEC Audit Findings on Pat Heung Ventilation Building Works Area

Mott MacDonald

Our ref KMY/AFK/FY/TK/T264090/22.01/L-0193
T 2828 5757
E anne.kerr@mottmac.com.hk
Your ref -

MTR Corporation Ltd.
8/F MTR Fo Tan Railway House,
No.9 Lok King Street,
Fo Tan,
Shatin, N.T.

11 August 2011
By Post and Email

Attn : Dr. Glenn Frommer

Dear Sir

Express Rail Link
Consultancy Agreement No. C806
Independent Environmental Checker (IEC)
Environmental Permit No.: EP-349/2009/B
Contract 822 - Pat Heung Ventilation Building Works Area

Please find enclosed our audit findings on the Pat Heung Ventilation Building Works Area for your record.

Should you have any queries, please contact the undersigned at 2828 5793.

Yours faithfully,
for MOTT MACDONALD HONG KONG LIMITED

Dr. Anne Kerr
Independent Environmental Checker (IEC)

Encl.

IEC Audit Findings on Pat Heung Ventilation Building Works Area

Background

A joint site visit with EPD, MTR and the Contractor was undertaken on 28 July to review the environmental acceptability of the works at Pat Heung Ventilation Building works area.

The progress and programme of works, applications for different license/permits under the environmental protection laws and copies of all valid license/permits at Pat Heung Ventilation Building works area were inspected.

Findings of the Audit

Based on the IEC monthly site inspection records, the surface condition of the Pat Heung Works Area between late June 2011 and at the time of preparation of this audit report generally remains the same.

It was confirmed by MTR and the Contractor that the temporary pipe as observed on site forms part of the local stream diversion as discussed in the approved XRL EIA Report. Water flow in the local stream being temporarily diverted to downstream by using this temporary pipe, restricts the excavation works to be conducted within an enclosed dry section of the local stream.

MTR and Contractor had ascertained that the site supporting works as shown in Photo No.1 are temporary and are needed to facilitate the works for the local stream diversion. As explained by the MTR / Contractor, the slopes reinforcement as shown in Photo No.1 are temporary for the establishment of a safe access of the temporary access road which forms part of the tunnel construction works. These temporary works relating to the construction of the tunnel were not specifically detailed in the Construction Works Sites Boundary under Figure 1 in EP-349/2009/B and Works Area under Figure NOL/ERL/300/C/XRL/ENS/M50/005 in EM&A Manual.

During the preparation of the EIA report, the method of construction was being developed to allow the assessment of the impacts to be undertaken in accordance with the EIAO-TM and the EIA Study Brief. In the intervening period, the design has developed and the Contractor has developed his specific method of construction which inevitably requires some activities to facilitate the works to be undertaken and constructed in a safe manner. This is not unusual process in the development of projects.

MTR was reminded to ensure compliance with the approved XRL EIA Report and current EP, and that measures should be taken to ensure all works carried out are within the relevant works boundary as defined in the approved XRL EIA Report and current EP.

The information provided herein relates to the IEC's duties only and does not refer to those of the Contractor and information that relates to the temporary works.

Photo No.1 Pat Heung Ventilation Building Works Area as observed on 7 June 2011

