



Expansion of Hong Kong International Airport into a Three-Runway System

Construction Phase Annual EM&A Report No.10

July 2026

Mott MacDonald
3/F Manulife Place
348 Kwun Tong Road
Kwun Tong
Kowloon
Hong Kong

T +852 2828 5757
mottmac.hk

Expansion of Hong Kong International Airport into a Three-Runway System

Construction Phase Annual EM&A Report No.10

July 2026

**This Construction Phase Annual EM&A Report No. 10 has been reviewed
and certified by**

the Environmental Team Leader (ETL) in accordance with

Section 15.5 of the Updated EM&A Manual

Certified by:

A handwritten signature in black ink, appearing to read 'Terence Kong', is positioned above a horizontal line.

Terence Kong
Environmental Team Leader (ETL)
Mott MacDonald Hong Kong Limited

Date: 28 July 2026



AECOM
19/F, Tower A, 83 King Lam Street
Cheung Sha Wan, Kowloon
Hong Kong
香港九龍長沙灣
瓊林街 83 號 A 座 19 樓
www.aecom.com

+852 3922 9000 tel
+852 3922 9797 fax

Our Ref : 60440482/C/RMKY260728

By Email

Airport Authority Hong Kong
HKIA Tower, 1 Sky Plaza Road
Hong Kong International Airport
Lantau, Hong Kong

Attn: Mr. Lawrence Tsui, Principal Manager, Environmental Compliance

28 July 2026

Dear Sir,

Contract No. 3102
3RS Independent Environmental Checker Consultancy Services

Submission of Construction Phase Annual EM&A Report No.10

Reference is made to the Environmental Team's submission of the Construction Phase Annual EM&A Report No.10 under Condition 15.5 of the Updated EM&A Manual certified by the ET Leader on 28 July 2026.

We would like to inform you that we have no adverse comment on the captioned submission. Therefore, we write to verify the captioned submission in accordance with the requirement stipulated in Condition 2.3 of EP-489/2014.

Should you have any query, please feel free to contact the undersigned at 37290380.

Yours faithfully,
AECOM Asia Co. Ltd.

Roy Man
Independent Environmental Checker

Contents

Abbreviations	1
Executive summary	3
1 Introduction	7
1.1 Background	7
1.2 Scope of this Report	7
1.3 Project Organization	7
1.4 Contact Information for the Project	11
1.5 Summary of Construction Works	11
1.6 Summary of EM&A Programme Requirements	11
2 Environmental Monitoring and Auditing	16
2.1 Air Quality Monitoring	16
2.1.1 Action and Limit Levels	16
2.1.2 Monitoring Results	16
2.1.3 Conclusion	17
2.2 Noise Monitoring	17
2.2.1 Action and Limit Levels	17
2.2.2 Monitoring Results	18
2.2.3 Conclusion	18
2.3 Water Quality Monitoring	19
2.4 Waste Monitoring	19
2.4.1 Action and Limit Levels	19
2.4.2 Summary of Monitoring Results	19
2.4.3 Marine Sediment Management	20
2.5 Chinese White Dolphins	26
2.5.1 Summary of Monitoring Results	27
2.5.2 Discussion on CWD Monitoring Results	33
2.5.3 Conclusions of CWD Monitoring Results	37
2.5.4 Site Audit for CWD-related Mitigation Measures	40
2.6 Sewage Flow Monitoring	40
2.7 Landscape and Visual Mitigation Measures	41
2.7.1 The Implementation Status of the Environmental Protection Measures	42
2.8 Environmental Site Inspection	50
2.9 Audit of the SkyPier High Speed Ferries	51
2.10 Audit of the Construction and Associated Vessels	51
2.11 External Stakeholder Engagement	52
2.11.1 Community Liaison Groups	52

2.11.2	Professional Liaison Group and Green Non-Governmental Organizations	53
2.11.3	Fishermen Liaison	53
2.11.4	Other Stakeholders	53
2.12	Review of the Key Assumptions Adopted in the EIA Report	53
2.13	Key Environmental Issues for the Coming Reporting Period	53

3 Report on Non-compliance, Complaints, Notifications of Summons and Prosecutions 55

3.1	Compliance with Other Statutory Environmental Requirements	55
3.2	Analysis and Interpretation of Complaints, Notification of Summons and Status of Prosecutions	55
3.2.1	Complaints	55
3.2.2	Notifications of Summons or Status of Prosecution	55
3.3	Cumulative Statistics	55

4 Conclusion and Recommendation 56

Tables

Table 1.1:	Contact Information of Key Personnel	8
Table 1.2:	Contact Information of the Project	11
Table 1.3:	Summary of Status for All Environmental Aspects under the Manual	12
Table 2.1:	Impact Air Quality Monitoring Stations	16
Table 2.2:	Percentage of Air Quality Monitoring Results within Action and Limit Levels	16
Table 2.3:	General Meteorological Condition during Impact Air Quality Monitoring	17
Table 2.4:	Impact Noise Monitoring Stations	17
Table 2.5:	Percentage of Noise Monitoring Results within Action and Limit Levels	18
Table 2.6:	General Weather Condition during Impact Noise Monitoring	18
Table 2.7:	Action and Limit Levels of the Construction Waste	19
Table 2.8:	Statistics of Construction Waste Generated in the Reporting Period	20
Table 2.9:	Universal Treatment Standards for On-site Reuse of Sediment Treated by Cement Mixing and Stabilization	21
Table 2.10:	Summary of Marine Sediment Testing Results for Sampling Grids within the Reclaimed Land Area with Excavation	22
Table 2.11:	Summary of Backfilling Status of Marine Sediment within the Reclaimed Land Area	25
Table 2.12:	Monitoring Programme for Landscape and Visual	41
Table 2.13:	Event and Action Plan for Landscape and Visual	41
Table 2.14:	Implementation Status of the Environmental Protection Measures	42
Table 2.15:	Summary of the Number of Retained, Transplanted and To-be-transplanted Trees as of December 2025	44

Table 2.16: Summary of the Tree Status Changes between end 2024 and end 2025	45
Table 2.17: Details of the Transplanted Trees	46
Table 2.18: Photos of the Existing Transplanted Trees in the Reporting Period	47
Table 2.19: Summary of Key Audit Findings against the SkyPier Plan	51

Figures

Figure 1.1	Locations of Key Construction Activities
Figure 2.1	Locations of Air and Noise Monitoring Stations and Chek Lap Kok Wind Station
Figure 2.2	Overall Sampling Grids for the Newly Reclaimed Area
Figure 2.3	The Backfilling Locations for Treated Marine Sediment
Figure 2.4	Vessel based Dolphin Monitoring Transects in Construction, Post-Construction and Operation Phases

Appendices

Appendix A	Contract Description
Appendix B	Project Organization Chart
Appendix C	Environmental Mitigation Implementation Schedule (EMIS) for Construction Phase
Appendix D	Monitoring Results
Appendix E	Chinese White Dolphin Monitoring Results
Appendix E.1	Voluntary Supplementary Surveys Results
Appendix F	Summary of Environmental Complaints and Cumulative Statistics on Exceedances, Notification of Summons, and Prosecution
Appendix G	Tree Schedule

Abbreviations

3RS	Three-Runway System
AAHK	Airport Authority Hong Kong
AECOM	AECOM Asia Company Limited
ACE	Advisory Council on the Environment
AFCD	Agriculture, Fisheries and Conservation Department
AIS	Automatic Identification System
ANI	Encounter Rate of Number of Dolphins
APM	Automated People Mover
AW	Airport West
BHS	Baggage Handling System
CAP	Contamination Assessment Plan
CAR	Contamination Assessment Report
CDS	Conventional Distance Sampling
CLGs	Community Liaison Groups
COVID	Coronavirus Disease
CWD	Chinese White Dolphin
CV	Coefficient of Variation
DCM	Deep Cement Mixing
DEZ	Dolphin Exclusion Zone
DPSE	Number of Dolphins per 100 Units of Survey Effort
EIA	Environmental Impact Assessment
EM&A	Environmental Monitoring & Audit
EP	Environmental Permit
EPD	Environmental Protection Department
EVT	Eastern Vehicular Tunnel
ET	Environmental Team
HDD	Horizontal Directional Drilling
HKIA	Hong Kong International Airport
HOKLAS	The Hong Kong Laboratory Accreditation Scheme
HSFs	High Speed Ferries
HZMB	Hong-Kong-Zhuhai-Macao Bridge
IEC	Independent Environmental Checker

LKC	Lung Kwu Chau
MCDS	Multiple Covariate Distance Sampling
MTCC	Marine Traffic Control Centre
MMHK	Mott MacDonald Hong Kong Limited
MMWP	Marine Mammal Watching Plan
MSS	Maritime Surveillance System
MTRMP-CAV	Marine Travel Routes and Management Plan for Construction and Associated Vessel
NEL	Northeast Lantau
NLMP	North Lantau Marine Park
NWL	Northwest Lantau
RBRGs	Risk Based Remediation Goals
SC	Sha Chau
SCLKCMP	Sha Chau and Lung Kwu Chau Marine Park
SCZ	Speed Control Zone
SPSE	Number of On-effort Sightings per 100 Units of Survey Effort
SPS-1	Sewage Pumping Station 1
STG	Encounter Rate of Number of Dolphin Sightings
SWL	Southwest Lantau
The Project	The Expansion of Hong Kong International Airport into a Three-Runway System
The SkyPier Plan	Marine Travel Routes and Management Plan for High Speed Ferries of SkyPier
T2	Terminal 2
T2C	Terminal 2 Concourse
TCLP	Toxicity Characteristics Leaching Procedure
TSP	Total Suspended Particulates
UCS	Unconfined Compressive Strength
WL	West Lantau
WMP	Waste Management Plan
WVT	Western Vehicular Tunnel

Executive summary

The “Expansion of Hong Kong International Airport into a Three-Runway System” (the Project) serves to meet the future air traffic demands at Hong Kong International Airport (HKIA). On 7 November 2014, the Environmental Impact Assessment (EIA) Report (Register No.: AEIAR-185/2014) for the Project was approved and an Environmental Permit (EP) (Permit No.: EP-489/2014) was issued for the construction and operation of the Project.

Airport Authority Hong Kong (AAHK) commissioned Mott MacDonald Hong Kong Limited (MMHK) to undertake the role of Environmental Team (ET) for carrying out the Environmental Monitoring & Audit (EM&A) works during the construction phase of the Project in accordance with the Updated EM&A Manual (the Manual).

This is the 10th Construction Phase Annual EM&A Report for the Project which summarizes the monitoring results and audit findings of the EM&A programme during the reporting period from 1 January 2025 to 31 December 2025.

The new North Runway was commissioned in November 2022. Following the completion of reconfiguration works on the Centre Runway, the Three-Runway System (3RS) was commissioned on 28 November 2024. The expanded Terminal 2 (T2) is being launched in phases, with the first phase of operation commenced on 23 September 2025.

Key Activities in the Reporting Period

Key activities of the Project carried out in the reporting period were related to the following contracts:

Reclamation Works:

Contract 3206 Main Reclamation Works

- Installation of precast units, scour apron, armour rocks and miscellaneous works at eastern seawall.

Airfield Works:

Contract 3305 Airfield Ground Lighting System

- Cable laying works;
- Hardware installation works; and
- Defects rectification.

Contract 3310 North Runway Modification Works

- Architectural, builder's work and finishing (ABWF) works at ancillary buildings;
- Construction of stormwater drainage, pavement, and underground utilities works;
- Construction of vehicular tunnel;
- Reinforced concreting works;
- Falsework and formwork; and
- Drainage and watermain works.

Terminal 2 Concourse and Apron Works:

Contract 3404 Integrated Airport Control System

- System testing and maintenance.

Contract 3408 Third Runway Concourse and Apron Works

- Reinforced concrete, building services and ABWF;
- Cable laying and utilities works; and

- Pavement works; and Operation of concrete batching plant.

Terminal 2 Expansion:

Contract 3508 Terminal 2 Expansion Works

- Pier, deck, parapet and drainage construction;
- Drainage construction and utilities works;
- Roof works, construction of beams and columns;
- Link bridge, crossroad duct laying, and utilities works;
- Abutment construction;
- Electrical & mechanical (E&M) works and ABWF; and
- Hard landscape works.

Automated People Mover and Baggage Handling System:

Contract 3601 New Automated People Mover System (TRC Line)

- Guidebeam installation; and
- Cable containment and laying works.

Contract 3602 Existing APM System Modification Works

- Restoration of buffer stop and stinger;
- Car commissioning running tests;
- Platform screen door installation works; and
- Steel fixing and formwork to track plinth.

Contract 3603 3RS Baggage Handling System (BHS)

- IT cabling, steel works, conveyor, fire service and lighting system installation; and
- E&M component installation.

Airport Support Infrastructure:

Contract 3801 APM and BHS Tunnels on Existing Airport Island

- Drainage and backfilling works; and
- Road pavement works.

Contract 3802 APM and BHS Tunnels and Related Works

- Excavation, lateral supports and backfilling works;
- APM and BHS Tunnel, box culvert construction and superstructure works; and
- Reinforced concrete works and ABWF.

Contract 3804 East and Landside Fire Stations

- Superstructure works and ABWF; and
- E&M, utilities and defect works.

Contract 3805 New Airport District Police Operational Base

- Pile cap and site formation works;
- Dog kennel construction;
- Construction of superstructure and drainage system; and
- Installation of fuel tank.

Construction Support:

Contract 3901A Concrete Batching Facility

- Operation of concrete batching plant and material conveyor belt.

Contract 3901B Concrete Batching Facility

- Operation of concrete batching plant and material conveyor belt; and
- Decommissioning of concrete batching plant.

Contract 3908 Quay Management Services

- Provision of services of site management and logistic control of 3RS quays; and
- Provision of flat top barge and vehicle delivery services between the launching point in Hong Kong and 3RS quays.

Contract 3913 Asphalt Batching Plant

- Operation of asphalt batching plant.

Utilities:

132kV Cable

- Cable laying and duct installation.

EM&A Activities Conducted in the Reporting Period

The EM&A programme was undertaken in accordance with the Manual. Summary of monitoring activities during this reporting period is presented as below:

Monitoring/ Audit Activities	Number of Sessions
Air Quality Monitoring	384
Noise Monitoring	208
Vessel line-transect Surveys for operation phase Chinese White Dolphin (CWD) Monitoring	24

Environmental auditing works, including weekly site inspections of construction works conducted by the ET and bi-weekly site inspections conducted by the Independent Environmental Checker (IEC), audit of SkyPier High Speed Ferries (HSFs), audit of construction and associated vessels, and Dolphin Exclusion Zone (DEZ) Plan, were conducted in the reporting period. Based on the information including ET's observations, records of Maritime Surveillance System (MSS), and contractors' site records, it is noted that the environmental pollution control and mitigation measures were properly implemented and the construction activities of the Project in the reporting period did not introduce adverse impact to the environment.

Summary Findings of the EM&A Programme

The monitoring works for construction dust, construction noise, construction waste, landscape & visual, and operation phase CWD monitoring were conducted during the reporting period in accordance with the Manual.

Monitoring results of construction dust, construction noise and construction waste did not trigger the corresponding Action and Limit Levels in the reporting period. No non-conformities were recorded for landscape & visual monitoring in the reporting period.

Following the full commissioning of the 3RS, the scale of active construction activities has been significantly reduced. A proposal to scale down the air quality and construction noise impact monitoring was submitted to EPD and subsequently approved by EPD on 31 December 2025. Starting from January 2026, monitoring stations AR1A and NM1A are retained to continue air quality and construction noise impact monitoring, respectively.

A 12-month operation phase CWD monitoring by vessels line-transect survey commenced in January 2025 and was completed in December 2025.

Summary Table

The key findings of the EM&A programme during the reporting period are summarised as below:

	Yes	No	Details	Analysis / Recommendation / Remedial Actions
Breach of Limit Level^		√	No exceedances of project-related Limit Level were recorded.	Nil
Breach of Action Level^		√	No exceedances of project-related Limit Level were recorded.	Nil.
Complaints Received	√		Three complaints were received in 2025: 14 Jan, 25 Apr and 7 Aug 2025.	The complaint investigations were carried out in accordance with the Complaint Management Plan. Details are presented in Section 3.2.1.
Notification of any summons and status of prosecutions		√	No notification of summons nor prosecution was received.	Nil
Changes that affect the EM&A		√	There was no change to the construction works that may affect the EM&A.	Nil

Remarks: ^ Only triggering of Action or Limit Level found related to Project works is counted as Breach of Action or Limit Level.

1 Introduction

1.1 Background

On 7 November 2014, the Environmental Impact Assessment (EIA) Report (Register No.: AEIAR-185/2014) for the “Expansion of Hong Kong International Airport into a Three-Runway System” (the Project) was approved and an Environmental Permit (EP) (Permit No.: EP-489/2014) was issued for the construction and operation of the Project.

Airport Authority Hong Kong (AAHK) commissioned Mott MacDonald Hong Kong Limited (MMHK) to undertake the role of Environmental Team (ET) for carrying out the Environmental Monitoring & Audit (EM&A) works during the construction phase of the Project in accordance with the Manual¹ submitted under EP Condition 3.1. AECOM Asia Company Limited (AECOM) was employed by AAHK as the Independent Environmental Checker (IEC) for the Project.

The Project covers the expansion of the existing airport into a Three-Runway System (3RS) with key project components comprising land formation of about 650 hectares and all associated facilities and infrastructure including taxiways, aprons, aircraft stands, a passenger concourse, an expanded Terminal 2, all related airside and landside works and associated ancillary and supporting facilities. The submarine aviation fuel pipelines and submarine power cables also require diversion as part of the works.

Construction of the Project is to proceed in the general order of diversion of the submarine aviation fuel pipelines, diversion of the submarine power cables, land formation, and construction of infrastructure, followed by construction of superstructures.

The summary of construction works programme can be referred to the corresponding Monthly EM&A Reports. Description of relevant contracts in the reporting period is presented in **Appendix A**.

1.2 Scope of this Report

This is the 10th Construction Phase Annual EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 1 January 2025 to 31 December 2025.

1.3 Project Organization

The Project’s organization structure and the contact details of the key personnel are provided in **Appendix B** and **Table 1.1** respectively.

¹ The Manual is available on the Project’s dedicated website (accessible at: <http://env.threerunwaysystem.com/en/index.html>).

Table 1.1: Contact Information of Key Personnel

Party	Position	Name	Telephone
Project Manager's Representative (Airport Authority Hong Kong)	Principal Manager, Environmental Compliance, Sustainability	Lawrence Tsui	2183 2734
Environmental Team (ET) (Mott MacDonald Hong Kong Limited)	Environmental Team Leader	Terence Kong	2828 5919
	Deputy Environmental Team Leader	Ken Wong	2828 5817
Independent Environmental Checker (IEC)	Independent Environmental Checker	Roy Man	3729 0380
(AECOM Asia Company Limited)	Deputy Independent Environmental Checker	Jackel Law	3856 5312

Reclamation Works:

Party	Position	Name	Telephone
Contract 3206 Main Reclamation Works	Project Manager	Alan Mong	3763 1352
(ZHEC-CCCC-CDC Joint Venture)	Environmental Officer	Zhang Bin Wang	3763 1451

Airfield Works:

Party	Position	Name	Telephone
Contract 3305 Airfield Ground Lighting System	Project Manager	Allam Al-Turk	2944 9725
(ADB Safegate Hong Kong Limited)	Environmental Officer	Ivan Ting	9222 9490
Contract 3310 North Runway Modification Works (China State Construction Engineering (Hong Kong) Ltd.)	Project Manager	Terry Chow	6031 0887
	Environmental Officer	Federick Wong	9842 2703

Terminal 2 Concourse and Apron Works:

Party	Position	Name	Telephone
Contract 3404 Integrated Airport Control System	Project Manager	Andy Ng	9102 2739
(Shun Hing Systems Integration Co., Ltd.)	Environmental Officer	Michael Lo	6228 3926
Contract 3405 Third Runway Concourse Foundation and Substructure Works (China Road and Bridge Corporation – Bachy Soletanche Group Limited – LT Sambo Co., Ltd. Joint Venture)	Project Manager	Francis Choi	9423 3469
	Environmental Officer	Jacky Lai	9028 8975

Party	Position	Name	Telephone
Contract 3408 Third Runway Concourse and Apron Works	Senior HSE Manager	Qian Zhang	5377 7976
(Beijing Urban Construction Group Company Limited and Chevalier (Construction) Company Limited Joint Venture)	Environmental Officer	Ivan Mak	9422 4805

Terminal 2 Expansion:

Party	Position	Name	Telephone
Contract 3508 Terminal 2 Expansion Works	Project Manager	Richard Ellis	6201 5637
(Gammon Engineering & Construction Company Limited)	Environmental Officer	Carrie Kwan	9276 0551

Automated People Mover and Baggage Handling System:

Party	Position	Name	Telephone
Contract 3601 New Automated People Mover System (TRC Line)	Project Manager	Hongdan Wei	158 6180 9450
(CRRC Puzhen Bombardier Transportation Systems Limited and CRRC Nanjing Puzhen Co., Ltd. Joint Venture)	Environmental Officer	H Y Yue	9185 8186
Contract 3602 Existing APM System Modification Works	Project Manager	Xia Bo	6586 4950
(Niigata Transys Co., Ltd.)	Environmental Officer	Y M Tong	5316 9801
Contract 3603 3RS Baggage Handling System	Project Manager	K C Ho	9272 9626
(VISH Consortium)	Environmental Officer	Richard Ng	9802 9577

Airport Support Infrastructure:

Party	Position	Name	Telephone
Contract 3801 APM and BHS Tunnels on Existing Airport Island	Contractor Representative	Ivan Lai	9507 6464
(China State Construction Engineering (Hong Kong) Ltd.)			
Contract 3802 APM and BHS Tunnels and Related Works	Project Manager	John Adams	6111 6989
(Gammon Engineering & Construction Company Limited)	Environmental Officer	Yan Ng	5345 8555

Party	Position	Name	Telephone
Contract 3804 East and Landside Fire Stations (Beijing Urban Construction Group Company Limited - Beijing Urban Construction International Company Limited - Kin Shing (Leung's) General Contractors Ltd Joint Venture)	Project Manager	Zhang Jinyuan	6708 0506
	Environmental Representative	Karis Lam	6084 9745
Contract 3805 New Airport District Police Operational Base (Chinney Construction Co., Ltd.)	Project Manager	Peter Li	9628 0768
	Environmental Officer	Mike Li	6306 8547

Construction Support:

Party	Position	Name	Telephone
Contract 3721 Construction Support Infrastructure Works (China State Construction Engineering (Hong Kong) Ltd.)	Senior Project Manager	Thomas Lui	9011 5340
	Environmental Officer	John Mak	6273 8703
Contract 3728 Minor Site Works (Shun Yuen Construction Company Limited)	Contract Manager	C K Liu	9194 8739
	Environmental Officer	Dan Leung	6856 5899
Contract 3733 Emergency Repair Service (Wing Hing Construction Co., Ltd.)	Project Manager	Michael Kan	9206 0550
	Health Safety Environmental Manager	Mike Leung	6625 2550
Contract 3901A Concrete Batching Facility (K. Wah Concrete Company Limited)	Project Manager	Benedict Wong	9553 2806
	Environmental Officer	C P Fung	9874 2872
Contract 3901B Concrete Batching Facility (Gammon Construction Limited)	General Manager	Gabriel Chan	2435 3260
	Environmental Officer	Rex Wong	2695 6319
Contract 3913 Asphalt Batching Plant (SPR Joint Venture)	Project Manager	Xie Yi Sheng	6580 6005
	Environmental Officer	Kenneth Chan	9300 2182

Utilities:

Party	Position	Name	Telephone
132kV Cable	Engineer	Ken Fung	6391 9087
(CLP Power Hong Kong Limited / Kum Shing (K.F.) Construction Company Limited)	Works Supervisor	Bosco Leung	6370 0780

1.4 Contact Information for the Project

The contact information for the Project is provided in **Table 1.2**. The public can contact us through the following channels if they have any queries and comments on the environmental monitoring data and project related information.

Table 1.2: Contact Information of the Project

Channels	Contact Information
Hotline	3908 0354
Email	env@3rsproject.com
Fax	3747 6050
Postal Address	Airport Authority Hong Kong HKIA Tower 1 Sky Plaza Road Hong Kong International Airport Lantau Hong Kong Attn: Environmental Team Leader Mr Terence Kong c/o Mr Lawrence Tsui

1.5 Summary of Construction Works

During the reporting period, the expanded Terminal 2 (T2) was launched in phases, with the first phase of operation commenced on 23 September 2025. This phase involved the opening of the indoor Coach Hall, which provides 41 parking spaces for tour buses, cross boundary coaches, limousines, and resident coaches.

The key activities of the Project carried out in the reporting period are located in reclamation areas and existing airport island respectively. Works in the reclamation areas included rock armour laying works, filling, pavement works, Terminal 2 concourse superstructure works, tunnel works for Automated People Mover (APM) and Baggage Handling System (BHS) and associated works. Meanwhile, works on existing airport island involved mainly Terminal 2 expansion works, modification and tunnel works for APM and BHS, utilities works, road and drainage works, excavation works and 132kV cable laying works.

The locations of the key construction activities are presented in **Figure 1.1**.

1.6 Summary of EM&A Programme Requirements

The status for all environmental aspects is presented in **Table 1.3**.

Table 1.3: Summary of Status for All Environmental Aspects under the Manual

Parameters	EM&A Requirements	Status
Air Quality		
Baseline Monitoring	At least 14 consecutive days before commencement of construction work	The baseline air quality monitoring results were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4.
Impact Monitoring	At least 3 times every 6 days	On-going
Noise		
Baseline Monitoring	Daily for a period of at least two weeks prior to the commencement of construction works	The baseline noise monitoring results were reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4.
Impact Monitoring	Weekly	On-going
Water Quality		
General Baseline Water Quality Monitoring for reclamation, water jetting and field joint works	Three days per week, at mid-flood and mid-ebb tides, for at least four weeks prior to the commencement of marine works.	The baseline water quality monitoring results were reported in Baseline Water Quality Monitoring Report and submitted to EPD under EP Condition 3.4.
General Impact Water Quality Monitoring for reclamation, water jetting and field joint works	Three days per week, at mid-flood and mid-ebb tides.	General impact water quality monitoring for water jetting works was completed on 23 May 2017. The general impact water quality monitoring was terminated after 31 October 2023.
Initial Intensive Deep Cement Mixing (DCM) Water Quality Monitoring	At least four weeks	The Initial Intensive DCM Monitoring Report was submitted and approved by EPD in accordance with the Detailed Plan on DCM.
Regular DCM Water Quality Monitoring	Three times per week until completion of DCM works.	Due to the completion of all marine-based DCM works within April 2022, regular DCM monitoring was ceased at all monitoring stations starting from 28 April 2022.
Post-construction Phase Water Quality Monitoring	Three days per week, at mid-flood and mid-ebb tides for four weeks	The four-week post-construction phase water quality monitoring exercise was commenced on 14 November 2023 and completed on 9 December 2023.
Sewerage and Sewage Treatment		
Methodology for carrying out annual sewage flow monitoring for concerned gravity sewer	Methodology to be prepared and submitted to EPD at least one year before commencement of the operation of 3RS	The proposed methodology for the annual sewage flow monitoring was approved by EPD. The annual flow monitoring commenced from June 2021 and was concluded in December 2022.
Details of the routine H ₂ S monitoring system for the sewerage system of 3RS	Details to be prepared and submitted to EPD at least one year before commencement of the operation of 3RS	Details of the routine H ₂ S monitoring system for sewerage systems of 3RS was approved by EPD. The H ₂ S monitoring is on-going.
Waste Management		
Waste Monitoring	At least weekly	On-going
Land Contamination		
Supplementary Contamination Assessment Plan (CAP)	At least 3 months before commencement of any soil remediation works.	The Supplementary CAP was submitted and approved by EPD pursuant to EP condition 2.20.

Parameters	EM&A Requirements	Status
Site Re-appraisal Summary Report for Fire Training Facility	Site Re-appraisal Summary Report for Fire Training Facility	Site Re-appraisal Summary Report for Fire Training Facility was submitted and accepted by EPD.
Contamination Assessment Report (CAR)	CAR to be submitted for golf course	The CAR for Golf Course was submitted and accepted by EPD.
	CAR to be submitted for Terminal 2 Emergency Power Supply Systems	The CARs for Terminal 2 Emergency Power Supply Systems were submitted and accepted by EPD.
Terrestrial Ecology		
Pre-construction Egret Survey Plan	Once per month in the breeding season between April and July, prior to the commencement of HDD drilling works.	The revised Egret Survey Plan was submitted and approved by EPD under EP Condition 2.14.
Ecological Monitoring	Monthly monitoring during the HDD construction works period from August to March.	The terrestrial ecological monitoring at Sheung Sha Chau was completed in January 2019.
Marine Ecology		
Pre-Construction Phase Coral Dive Survey	Prior to marine construction works	The Coral Translocation Plan was submitted and approved by EPD under EP Condition 2.12.
Coral Translocation	-	The coral translocation was completed on 5 January 2017.
Coral Post-translocation Monitoring	As per an enhanced monitoring programme based on the Coral Translocation Plan	The post-translocation monitoring programme according to the Coral Translocation Plan was completed in April 2018.
Chinese White Dolphins (CWD)		
Baseline Monitoring	6 months of baseline surveys before the commencement of land formation related construction works. Vessel line transect surveys: Two full surveys per month; Land-based theodolite tracking surveys: Two days per month at the Sha Chau station and two days per month at the Lung Kwu Chau station; and Passive Acoustic Monitoring (PAM): For the whole duration of baseline period.	Baseline CWD results were reported in the CWD Baseline Monitoring Report and submitted to EPD in accordance with EP Condition 3.4.
Impact Monitoring	Vessel line transect surveys: Two full surveys per month; Land-based theodolite tracking surveys: One day per month at the Sha Chau station and one day per month at the Lung Kwu Chau station; and PAM: For the whole duration for land formation related construction works.	The construction phase CWD monitoring was completed in December 2023.

Parameters	EM&A Requirements	Status
Post-construction Phase Monitoring	12 months of post monitoring upon the completion of marine construction works; and Vessel line transect survey: Two full surveys per month.	Post-construction phase CWD monitoring was completed in December 2024.
Operation Phase Monitoring	12 months of operation phase CWD monitoring upon full implementation of North Lantau Marine Park. Vessel line transect survey: Two full surveys per month.	Operation phase CWD monitoring was completed in December 2025.
Operation Phase Audit	SkyPier High Speed Ferries (HSFs) implementation measures: Once every three months for a period of one year upon operation of 3RS. Spill Response Plan implementation measures: Once every six months for a period of one year upon operation of 3RS.	Quarterly audits were conducted for one year following 3RS operation. The 4th audit was completed in November 2025, thereby completing the one-year audit programme. Half-yearly audits were conducted for one year following 3RS operation. The 2nd audit was completed in November 2025, thereby completing the one-year audit programme.
Landscape and Visual		
Landscape and Visual Plan	At least 3 months before the commencement of construction works on the formed land of the Project.	The Landscape & Visual Plan was submitted to EPD under EP Condition 2.18.
Baseline Monitoring	One-off survey within the Project site boundary prior to commencement of any construction works	The baseline landscape & visual monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under EP Condition 3.4.
Impact Monitoring	Weekly	On-going
Establishment Works Monitoring	Bi-monthly	On-going
Long Term Management (10 years) monitoring	Annually	On-going
Environmental Auditing		
Regular site inspection	Weekly	On-going
Marine Mammal Watching Plan (MMWP) implementation measures	Monitor and check	Marine Mammal Watching Plan (MMWP) implementation measures were conducted from May to September 2025.
Dolphin Exclusion Zone (DEZ) Plan implementation measures	Monitor and check	Dolphin Exclusion Zone (DEZ) Plan implementation measures were conducted from May to December 2025.
SkyPier High Speed Ferries (HSFs) implementation measures	Monitor and check	On-going
Construction and Associated Vessels implementation measures	Monitor and check	On-going
Complaint Hotline and Email channel	Construction phase	On-going
Environmental Log-book	Construction phase	On-going

Parameters	EM&A Requirements	Status
Silt Curtain Deployment Plan implementation measures	Monitor and check	All monitoring required under the Silt Curtain Deployment Plan was completed on 17 March 2025.
Spill Response Plan implementation measures	Monitor and check	On-going

Considering the nature of construction activities during the reporting period, impact monitoring was undertaken for air quality, noise, waste management, and landscape and visual. In addition, operation phase CWD monitoring was also carried out.

The EM&A programme also involved weekly site inspections and related auditing conducted by the ET for checking the implementation of the required environmental mitigation measures as recommended in the approved EIA Report. To promote the environmental awareness and enhance the environmental performance of the contractors, environmental trainings, and regular environmental management meetings were conducted during the reporting period which are summarized as below:

- 1 skipper training provided by ET; and
- 145 environmental management meetings for EM&A review with works contracts.

The EM&A programme has been undertaken in accordance with the recommendations presented in the approved EIA Report and the Manual. A summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix C**.

2 Environmental Monitoring and Auditing

2.1 Air Quality Monitoring

Impact 1-hour Total Suspended Particulates (TSP) monitoring was conducted three times every six days at two representative monitoring stations during the reporting period. The locations of the monitoring stations are described in **Table 2.1** and presented in **Figure 2.1**.

Following the full commissioning of the 3RS, the scale of active construction activities has been significantly reduced. A proposal to scale down the air quality monitoring was submitted to EPD and subsequently approved by EPD on 31 December 2025. Starting from January 2026, monitoring station AR2 was terminated and only AR1A has been retained to continue air quality monitoring.

2.1.1 Action and Limit Levels

The Action and Limit Levels of the air quality monitoring stipulated in the EM&A programme for triggering the relevant investigation and follow-up procedures under the programme are provided in **Table 2.1**.

Table 2.1: Impact Air Quality Monitoring Stations

Monitoring Station	Location	Action Level (µg/m ³)	Limit Level (µg/m ³)
AR1A	Man Tung Road Park	306	500
AR2	Village House at Tin Sum	298	

2.1.2 Monitoring Results

The graphical plots of impact air quality monitoring results during the reporting period are presented in **Appendix D**. Percentage of monitoring results within their corresponding Action and Limit Levels in the reporting period are presented in **Table 2.2**.

Table 2.2: Percentage of Air Quality Monitoring Results within Action and Limit Levels

	AR1A	AR2
Jan 2025	100%	100%
Feb 2025	100%	100%
Mar 2025	100%	100%
Apr 2025	100%	100%
May 2025	100%	100%
Jun 2025	100%	100%
Jul 2025	100%	100%
Aug 2025	100%	100%
Sep 2025	100%	100%
Oct 2025	100%	100%
Nov 2025	100%	100%
Dec 2025	100%	100%
Overall	100%	100%

Note:

The percentages are calculated by dividing the number of monitoring results within their corresponding Action and Limit Level by the total number of monitoring results.

All monitoring results at AR1A and AR2 were within their corresponding Action and Limit Levels.

General meteorological conditions throughout the impact monitoring period were recorded and are summarized in **Table 2.3**.

Table 2.3: General Meteorological Condition during Impact Air Quality Monitoring

	Weather	Wind Direction
Jan – Mar 2025	Sunny to Cloudy	Northwest to Southwest
Apr – Jun 2025	Sunny to Drizzle	Northwest to Southeast
Jul – Sep 2025	Sunny to Cloudy	Northwest to Southeast
Oct – Dec 2025	Sunny to Cloudy	Northwest to East

2.1.3 Conclusion

No dust emission sources were observed at the monitoring stations during the monitoring sessions. As the sensitive receivers were far away from the construction activities, with the implementation of dust control measures, there was no adverse impact at the sensitive receivers attributable to the works of the Project.

2.2 Noise Monitoring

Impact noise monitoring was conducted at four representative monitoring stations once per week during 0700 and 1900 in the reporting period. The locations of monitoring stations are described in **Table 2.4** and presented in **Figure 2.1**.

Following the full commissioning of the 3RS, the scale of active construction activities has been significantly reduced. A proposal to scale down the construction noise impact monitoring was submitted to EPD and subsequently approved by EPD on 31 December 2025. Starting from January 2026, monitoring stations NM2, NM3A, NM4, NM5 and NM6 were terminated and only NM1A has been retained to continue construction noise impact monitoring.

2.2.1 Action and Limit Levels

The Action and Limit levels of the noise monitoring stipulated in the EM&A programme for triggering the relevant investigation and follow-up procedures under the programme are provided in **Table 2.4**.

Table 2.4: Impact Noise Monitoring Stations

Monitoring Station	Location	Action Level	Limit Level, L _{eq(30mins)} dB(A)
NM1A	Man Tung Road Park	When one documented complaint is received from any one of the sensitive receivers	75 dB(A)
NM4	Ching Chung Hau Po Woon Primary School		65dB(A) / 70 dB(A) ⁽ⁱ⁾
NM5	Village House in Tin Sum		75 dB(A)
NM6	House No. 1, Sha Lo Wan		75 dB(A)

Notes:

- (i) The Limit Level for NM4 is reduced to 70dB(A) for being an educational institution. During school examination period, the Limit Level is further reduced to 65dB(A).
- (ii) As described in Section 4.3.3 of the Manual, impact noise monitoring at NM2 would only commence after occupation of the Tung Chung Development. According to the Tung Chung New Town Extension EIA Report (approved on 08 April 2016), the west reclamation area is no longer required and the occupation of

Monitoring Station	Location	Action Level	Limit Level, L _{eq(30mins)} dB(A)
(iii)	Tung Chung West Development will not take place. Thus, impact noise monitoring at NM2 is not required and will not be carried out.		
	According to Section 4.3.3 of the Manual, the noise monitoring at NM3A was temporarily suspended starting from 1 September 2018 and would be resumed upon the completion of the Tung Chung East Development.		

2.2.2 Monitoring Results

The graphical plots of impact noise quality monitoring results during the reporting period are presented in **Appendix D**. Percentage of monitoring results within their corresponding Action and Limit Levels in the reporting period are presented in **Table 2.5**.

Table 2.5: Percentage of Noise Monitoring Results within Action and Limit Levels

	NM1A	NM4	NM5	NM6
Jan 2025	100%	100%	100%	100%
Feb 2025	100%	100%	100%	100%
Mar 2025	100%	100%	100%	100%
Apr 2025	100%	100%	100%	100%
May 2025	100%	100%	100%	100%
Jun 2025	100%	100%	100%	100%
Jul 2025	100%	100%	100%	100%
Aug 2025	100%	100%	100%	100%
Sep 2025	100%	100%	100%	100%
Oct 2025	100%	100%	100%	100%
Nov 2025	100%	100%	100%	100%
Dec 2025	100%	100%	100%	100%
Overall	100%	100%	100%	100%

Note: The percentages are calculated by dividing the number of monitoring results within their corresponding Action and Limit Level by the total number of monitoring results.

No complaints were received from any sensitive receiver that triggered the Action Level.

General weather conditions throughout the impact monitoring period were recorded and are summarized in **Table 2.6**.

Table 2.6: General Weather Condition during Impact Noise Monitoring

	Weather
Jan – Mar 2025	Sunny to Cloudy
Apr – Jun 2025	Sunny to Cloudy
Jul – Sep 2025	Sunny to Cloudy
Oct – Dec 2025	Sunny to Cloudy

2.2.3 Conclusion

The dominant noise sources observed at the monitoring stations during the construction noise impact monitoring were road traffic noise near NM1A, school activities at NM4, and aircraft noise near NM6. As the sensitive receivers were far away from the construction activities, and with the

implementation of noise control measures, there was no adverse impact attributable to the works of the Project at the sensitive receivers.

2.3 Water Quality Monitoring

The construction phase water quality impact monitoring was carried out according to Section 5.1.8 of the Updated EM&A Manual. With the completion of land formation works including seawall construction and all marine filling works in the first quarter of 2023, termination of the construction phase water quality impact monitoring was proposed to EPD with approval granted on 30 October 2023. The water quality impact monitoring was terminated after 31 October 2023.

A post-construction phase water quality monitoring exercise was carried out for four weeks according to Section 5.1.10.1 of the Updated EM&A Manual, in the same manner as the impact monitoring at all impact monitoring stations, sensitive receiver stations and control stations during construction phase, from 14 November 2023 to 9 December 2023. The comparison between the baseline, construction phase and post-construction phase monitoring results was presented in the Annual EM&A report No.8. The post-construction phase water quality monitoring did not reveal any significant changes in water quality compared to the baseline monitoring. It can therefore be concluded that the marine works carried out during construction phase did not cause deterioration or adverse impacts on the marine water quality surrounding the Project site.

2.4 Waste Monitoring

In accordance with the Manual, the waste generated from construction activities was audited once per week to determine if waste was being managed in accordance with the Waste Management Plan (WMP) prepared for the Project, contract specific WMP, and any statutory and contractual requirements. All aspects of waste management including waste generation, storage, transportation, and disposal were reviewed during the audits.

2.4.1 Action and Limit Levels

The Action and Limit Levels of the construction waste are provided in **Table 2.7**.

Table 2.7: Action and Limit Levels of the Construction Waste

Monitoring Stations	Action Level	Limit Level
Construction Area	When one valid documented complaint is received	Non-compliance of the WMP, contract-specific WMPs, any statutory and contractual requirements

2.4.2 Summary of Monitoring Results

Weekly monitoring on all works contracts were carried out by the ET in the reporting period to check and monitor the implementation of proper waste management practices.

Recommendations made included provision and maintenance of proper chemical waste storage area, as well as proper handling, segregation, and regular disposal of general refuse. Paper, plastics, and metals were recycled in the reporting period. The contractors implemented the recommended measures to improve waste management issues. Waste management audits were carried out by ET according to the requirement of the WMP, the Manual, and the implementation schedule of the waste management mitigation measures in **Appendix C**.

The construction waste generated in the reporting period is summarized in **Table 2.8**.

Table 2.8: Statistics of Construction Waste Generated in the Reporting Period

	Construction and Demolition Material Stockpiled for Reuse or Recycle ⁽¹⁾ (m ³)	Construction and Demolition Material Reused in the Project (m ³)	Construction and Demolition Material Reused in other Projects (m ³)	Construction and Demolition Material Transferred to Public Fill (m ³)	Chemical Waste (kg)	Chemical Waste (L)	General Refuse (tonne)
Jan 2025	1,583	160	0	8,037	0	0	4,472
Feb 2025	8	11,494	0	7,826	350	0	2,959
Mar 2025	0	1,334	0	6,218	300	0	4,520
Apr 2025	760	1,885	0	4,680	0	0	4,336
May 2025	692	841	0	3,654	0	600	3,282
Jun 2025	782	577	0	2,964	0	0	3,209
Jul 2025	936	756	0	4,788 ⁽²⁾	0	0	3,533
Aug 2025	671	4,585	0	6,283 ⁽²⁾	0	2,000	3,217
Sep 2025	856	7,412	0	4,461 ⁽²⁾	0	0	3,675
Oct 2025	798	1,326	0	4,591	0	0	3,395
Nov 2025	1,492	65	0	3,834 ⁽²⁾	0	0	2,739
Dec 2025	839	0	0	4,642 ⁽²⁾	0	0	2,511
Total	9,417	30,435	0	61,978	650	2,600	41,848

Notes:

1. The excavated materials were temporarily stored at stockpiling area and would be reused in the Project.
2. Updated figures were provided by contractors

There were no complaints, non-compliances of the WMP, contract-specific WMPs, statutory and contractual requirements that triggered Action and Limit Levels in this reporting period.

2.4.3 Marine Sediment Management

Marine sediment was managed according to the EIA Report, Updated EM&A Manual and WMP and the proposal of Further Development on Treatment Level / Details and the Reuse Mode for Marine Sediment (hereinafter referred to as “Further Development Proposal”) of the Project. Based on EIA requirements, marine sediments would be treated using cement mixing and stabilisation/solidification method. All these treated sediments would be reused on-site as backfilling materials. The sampling process, storage conditions of the excavated marine sediment, treatment process, final backfilling location as well as associated records were inspected and checked by ET and verified by IEC to ensure they were in compliance with the requirements as stipulated in the WMP and Further Development Proposal.

The excavation and treatment of all marine sediment excavated from areas with ground improvement works by DCM (refer to Section 2.4.3.1) were completed in February 2025. For areas without ground improvement works by DCM (refer to Section 2.4.3.2), the treatment and backfilling of all marine sediment were completed in 2022.

2.4.3.1 Reclaimed Land Area with Ground Improvement Works by Deep Cement Mixing

With reference to the Further Development Proposal approved on 17 January 2020, the marine sediment generated from the areas with ground improvement works of the 3RS Project was treated in-situ with cement by DCM, and the excavated materials would be reused on-site without disposal to sea, it was considered more appropriate to have the excavated materials tested against Risk Based Remediation Goals (RBRGs). Therefore, as an alternative to the testing arrangement presented in the 3RS EIA Report, the assessment approach provided in the EPD's Practice Guide for Investigation and Remediation of Contaminated Land (hereafter referred to as "Practice Guide") was adopted and the quality of excavated marine sediment was assessed against the most stringent RBRG limits (for Rural Residential Land Use) for eight heavy metals including Arsenic, Cadmium, Chromium, Lead, Mercury, Nickel, Zinc and Copper.

If the testing results were below the RBRGs limits, no further environmental treatment would be required for the marine sediment materials excavated from the sampling grid. However, geotechnical treatment might require for marine sediment to improve the quality as backfilling materials. If there was RBRGs exceedance in a particular heavy metal at a certain sampling depth, only excavated sediment material from such sampling depth of the concerned sampling grid, would undergo further cement stabilization, before testing against the Toxicity Characteristics Leaching Procedure (TCLP) limit of the concerned heavy metal (heavy metal parameter exceeded RBRGs) before reuse. For TCLP limits, please refer to **Table 2.9** (Table 4.6 of the Practice Guide). The excavated sediment materials from such sampling depth with exceedance of RBRGs, would be tested against Unconfined Compressive Strength (UCS) after treatment. The UCS was defined based on respective engineering requirements. The testing frequency for TCLP was the same as that described in Section 10.5.1.14 of the approved EIA Report, i.e. one sample per 50 m³ for the first 1,000 m³ batch of excavated sediment materials. Provided that the samples meet the TCLP limit(s), the subsequent testing frequency would be reduced to be at least two samples per 10,000 m³ batch. In the event that the required level was not achieved, the concerned whole batch should be crushed and the material would be further handled and treated as necessary. The testing frequency should be revised to one sample per 50 m³ batch (with two further samples kept for contingency) and treated samples should be taken for laboratory testing. Once the concerned heavy metal complied with the particular TCLP limit, the previous sampling frequency of at least two samples per 10,000 m³ batch should be resumed.

Table 2.9: Universal Treatment Standards for On-site Reuse of Sediment Treated by Cement Mixing and Stabilization

Parameters ⁽¹⁾⁽²⁾	TCLP Limit (mg/L)
Arsenic	5
Cadmium	0.11
Total Chromium	0.6
Lead	0.75
Mercury	0.025
Nickel	11
Zinc	4.3

Notes:

1. Universal Treatment Standard – US 40 CFR 268.48
2. For copper, it must be reduced by at least 90% in mobility for copper through cement stabilization/solidification remedial treatment. The reduction of mobility of copper (leachable metals contaminant) should be confirmed through TCLP tests (i.e. to carry out TCLP test for the untreated sediment and for the sediment after treatment and to compare the concentrations of copper in the leachates).

A sampling grid size of 100 m x 100 m was adopted for locating sampling points for areas where marine sediment to be excavated from the newly reclaimed area. One marine sediment sample

was taken if the depth of marine sediment to be excavated was less than or equalled to 3 m. If the depth of marine sediment to be excavated was less than or equalled to 6 m, a sample was taken from the depth of 0 - 3 m, and 3 - 6 m. If the marine sediment to be excavated was more than 6 m, a sample was taken from three different depths including one in the depth of 0 - 3 m, 3 - 6 m, and 6 m to the bottom of the marine sediment to be excavated. All of the above tests were carried out by HOKLAS laboratory, and the results were checked by ET and IEC.

The tentative location of sampling grids where marine sediment is to be excavated from the newly reclaimed area land was presented in **Appendix A** of the Further Development Proposal. **Figure 2.2** illustrates all the sampling grids covering the areas where marine sediment was excavated from the newly reclaimed land. The sampling grid for each area is denoted by specific colour, the sampling grids with light green and light red shaded represent all sampling layer(s) passed RBRGs limit(s) and sampling layer(s) with parameter(s) exceeding RBRGs limit(s), respectively. Details of sampling ID and sampling depths are also presented in each sampling grid. The number of grids for sampling for each area, the number of grids with pass and fail of the RBRGs results and the number of grids with marine sediment not encountered within the final excavation level are all summarised in **Table 2.10**. All the marine sediment sampling works within the reclaimed land area were completed in 2023. However, as there is no schedule that excavation will be required for the western portion of the Terminal 2 Concourse (T2C) until completion of the works, marine sediment sampling is not required for this area at present and will be subject to future development.

Table 2.10: Summary of Marine Sediment Testing Results for Sampling Grids within the Reclaimed Land Area with Excavation

Sampling Area	Western Vehicular Tunnel and Airport North Fire Station	Eastern Vehicular Tunnel	Terminal 2 Concourse (T2C)	APM/BHS Tunnel and Ancillary Building with Piled Foundation
Total No. of Grids for Areas where Marine Sediment was Excavated (a)+(b)+(c)	16	11	36	34
No. of Grids with "Pass" RBRGs Results (a)	15	7	34	30
No. of Grids with "Fail" RBRGs Results (b)	0	0	2	3
No. of Grids with Marine Sediment Not Encountered within the Final Excavation Level (c)	1	4 ⁽¹⁾	0	1
Total No. of Grids for Areas where Excavation or Marine Sediment Sampling is not Required under Current Status	0	0	14 ⁽²⁾	0

Notes:

1. RBRG testing was conducted for one of the sampling grids and the testing results exceeded the RBRG limits. However, the contractor re-confirmed that the marine sediment excavation will not reach the "fail" RBRG level.
2. There is no schedule that excavation will be required at the western portion of the T2C until completion of the works. Therefore, no marine sediment sampling or excavation is required for this area under current status.

2.4.3.1.1 Western Vehicular Tunnel and Airport North Fire Station

The Western Vehicular Tunnel (WVT) and Airport North Fire Station were covered by Contracts 3303 and 3310. Out of the total of 16 sampling grids for WVT and Airport North Fire Station, 1

sampling grid was recorded with no marine sediment encountered within the final excavation level and the testing results of the remaining 15 sampling grids passed all the RBRGs limits.

Western Vehicular Tunnel

The construction of WVT was covered by Contracts 3303 and 3310. For Contract 3310, there was 1 sampling grid, and the testing result indicated no marine sediment was encountered within the final excavation level. Therefore, no marine sediment was generated from the works carried out by Contract 3310. For Contract 3303, there were 14 sampling grids, and all the testing results passed the RBRGs limits. A total of 508,506 m³ of treated marine sediment was backfilled, and the backfilling locations are shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2024.

Airport North Fire Station

The construction of Airport North Fire Station was covered by Contract 3303. There was 1 sampling grid for this area, and the testing results passed all the RBRGs limits. A total of 9,269 m³ of treated marine sediment was backfilled. The backfilling location is shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2024.

2.4.3.1.2 Eastern Vehicular Tunnel and Terminal 2 Concourse

The construction activities of Eastern Vehicular Tunnel (EVT) and Terminal 2 Concourse (T2C) were covered by Contracts 3310 and 3408 and 3405. Out of the total of 47 sampling grids for EVT and T2C, 4 sampling grids were recorded with no marine sediment encountered within the final excavation levels, 2 sampling grids with Arsenic exceeding the corresponding RBRGs limit were recorded and the testing results of the remaining 41 sampling grids passed all the RBRGs limits.

Eastern Vehicular Tunnel

The construction of EVT was covered by Contracts 3310 and 3408. For Contract 3310, there was 1 sampling grid, and the testing result indicated no marine sediment was encountered within final excavation level. Therefore, no marine sediment was generated from Contract 3310. For Contract 3408, out of a total of 10 sampling grids, 3 sampling grids were recorded with no marine sediment encountered within the final excavation level and the testing results of the remaining of 7 sampling grids passed all the RBRG limits. A total of 11,305 m³ of treated marine sediment was backfilled, and the backfilling locations are shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2025.

Terminal 2 Concourse

The construction of T2C was covered by Contract 3405. Out of the total of 36 sampling grids, 2 sampling grids were recorded with Arsenic exceeding the corresponding RBRGs limit and the testing results of the remaining 34 sampling grids passed all the RBRG limits. A total of 152,168 m³ of treated marine sediment, which includes the marine sediment that passed all the RBRGs limits and the marine sediment that exceeded RBRGs limit for Arsenic but had undergone environmental treatment, was backfilled and the backfilling locations are shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2024.

There is no schedule that excavation will be required at the western portion of the T2C until completion of the works. Therefore, marine sediment sampling is not required for this area under the current status. This would, however, be subject to any future development programme at this area.

2.4.3.1.3 APM / BHS Tunnel and Ancillary Buildings with Piled Foundations

The construction activities of APM / BHS Tunnel and Ancillary Buildings with Piled Foundations were covered by Contracts 3802, 3804 and 3805. Out of the total of 34 sampling grids for such areas, 1 sampling grid was recorded with no marine sediment encountered within the final excavation level, 3 sampling grids were recorded with Arsenic exceeding the corresponding RBRGs limit and the testing results of the remaining 30 sampling grids passed all the RBRGs limits.

APM / BHS Tunnel

The construction of APM/ BHS Tunnel was covered by Contract 3802. Out of 33 sampling grids completed under this contract, 1 sampling grid was recorded with no marine sediment encountered within the final excavation level, 3 sampling grids were recorded with Arsenic exceeding the corresponding RBRGs limit and the testing results of the remaining 29 sampling grids passed all the RBRGs limits. Up to this reporting period, a total of 952,108 m³ of treated marine sediment, including the marine sediment that passed all the RBRGs limits and the marine sediment that exceeded RBRGs limit for Arsenic but had undergone environmental treatment, were backfilled and the backfilling locations are shown in **Figure 2.3**. Additionally, 46,311 m³ of treated marine sediment is properly stockpiled at 3RS Project site area, awaiting backfilling and the backfilling location will be reported in the next annual report. Accordingly, the marine sediment excavation and treatment works were completed in this area in February 2025.

Ancillary Buildings with Piled Foundations

The construction activities of East Fire Station and Landside Fire Station were covered by Contract 3804. There was 1 sampling grid that was done by Contract 3804 and the testing result of the grid passed all the RBRGs limits. However, the excavation areas for East Fire station and Landside Fire Station spread over a total of 6 sampling grids, which include 5 sampling grids done by Contract 3802, namely, 3802-BHS/APM-Grids 6, 18, 19, 20 & 21, and 1 sampling grid done by Contract 3804, namely, 3804-EFS-Grid 34 (refer to **Figure 2.2**). Out of these 6 sampling grids, 1 sampling grid was recorded with Arsenic exceeding the corresponding RBRGs limit and the testing results of the remaining 5 sampling grids passed all the RBRGs limits. A total of 7,254 m³ of treated marine sediment, which includes the marine sediment that passed all the RBRGs limits and the marine sediment that exceeded RBRGs limit for Arsenic but had undergone environmental treatment, were backfilled, and the backfilling locations are shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2025.

The construction of New Airport District Police Operational Base was covered by Contract 3805. The excavation area for New Airport District Police Operational Base spreads over a total of 4 sampling grids that were done by Contract 3802, namely, 3802-BHS/APM-Grids 11, 13, 32 & 33 (refer to **Figure 2.2**), and the testing results of all these 4 sampling grids passed the RBRGs limits. Up to this reporting period, a total of 16,049 m³ of treated marine sediment was backfilled, and the backfilling location is shown in **Figure 2.3**. The marine sediment excavation and treatment works were completed in this area in 2024. However, another 1,159 m³ of treated marine sediment is stockpiled properly at 3RS Project site area awaiting backfilling and the backfilling location will be reported in the next annual report.

2.4.3.1.4 Summary of Backfilling of Marine Sediment within the Reclaimed Land Area

The backfilling locations of treated marine sediment, denoted by specific colours according to the excavation areas, are shown in **Figure 2.3**. A summary of the backfilling volumes, along with the status of marine sediment from different excavation areas, is presented in **Table 2.11**.

Table 2.11: Summary of Backfilling Status of Marine Sediment within the Reclaimed Land Area

Area	Western Vehicular Tunnel and Airport North Fire Station	Eastern Vehicular Tunnel	Terminal 2 Concourse	APM/BHS Tunnel	Ancillary Building with Piled Foundation
Contract No.	3303 and 3310 ^(a)	3408 and 3310 ^(a)	3405	3802	3804 and 3805
Status	Excavation, treatment and backfilling works completed in 2024.	Excavation, treatment and backfilling works completed in 2025.	Excavation, treatment and backfilling works completed in 2024.	Excavation and treatment works completed in February 2025. Backfilling to be completed.	Excavation and treatment works completed in 2025. Backfilling to be completed.
Volume of Treated and Backfilled Marine Sediment, m ³	508,506 + 9,269 = 517,775	11,305	152,168	952,108	7,254 + 16,049 = 23,303
Volume of Treated Marine Sediment awaiting backfilling, m ³	0	0	0	46,311	1,159

Notes:

(a) No marine sediment was generated from Contract 3310.

2.4.3.2 Area without Ground Improvement Works by Deep Cement Mixing

For the excavated marine sediment generated from the areas without ground improvement works by DCM (i.e. construction berth at Area C5 of the reclaimed land area, existing airport island area and approach light area), the excavated marine sediment was treated with cement and tested against the TCLP limits as provided in **Table 2.9**. The testing frequency follows Section 10.5.1.14 of the approved EIA Report, as detailed in Section 2.4.3.1. The treated marine sediment was tested against relevant engineering requirements to confirm their suitability as backfilling material for respective areas of different future uses. The UCS was also tested and defined based on respective engineering requirements.

As presented in the Annual EM&A Report No. 8, the marine sediment excavation, treatment and backfilling works for the areas without ground improvement works by DCM were completed in 2022 and there was no update during this reporting period. The following sections provide a summary on the volumes of excavated, treated and backfilled marine sediments for different areas as reproduced from the Annual EM&A Report No. 9.

2.4.3.2.1 Construction Berth at Area C5 of the Reclaimed Land Area

A construction berth was constructed at the eastern portion of newly reclamation area by Contract 3206. The marine sediment excavation, treatment and backfilling works were completed in this area in 2022. A total of 117 m³ of excavated and treated marine sediment was backfilled and the backfilling location is shown in **Figure 2.3**.

2.4.3.2.2 T2 Foundation and Substructure Works

Marine sediment was excavated and treated with cement stabilisation by Contract 3503. A total of 72 m³ of excavated and treated marine sediment was backfilled and the backfilling locations are shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2022.

2.4.3.2.3 Approach Light Area

The marine sediment generated from Approach Light Area was covered by Contract 3303. A total of 2,404 m³ of excavated and treated marine sediment was backfilled and the backfilling location

is shown in **Figure 2.3**. The marine sediment excavation, treatment and backfilling works were completed in this area in 2022.

2.5 Chinese White Dolphins

According to Sections 10.2.1.2 and 10.2.1.3 of the Updated EM&A Manual, CWD monitoring is required during the baseline, construction, post-construction and operation phases of the project. The construction and post-construction phase monitoring of CWDs ended in December 2023 and December 2024 respectively while the 12 months operation phase monitoring commenced on 1 January 2025 and was completed in December 2025.

The aims of CWD monitoring during the operation period are:

- to monitor the potential shift in the CWD travelling areas and habitat use;
- to provide a dataset compatible with the AFCD long-term monitoring, stratified in such a way as to allow the calculation of density and abundance for the different phases and to calculate the trends from these estimates;
- to detect any rebound in use of areas north and east of HKIA during the implementation of the North Lantau Marine Park as mitigation for habitat loss for the airport expansion; and
- to evaluate the overall, long-term impacts of the project on CWDs.

This section summarises the results of the CWD operation phase monitoring effort over a 12-month period from January 2025 through December 2025, to gather information on the spatial and temporal distribution patterns as well as calculate density and abundance of CWD in western Hong Kong waters. Supplementary information collected focusing on northwestern Lantau waters, including habitat use and behaviours of CWD during the post-construction phase of the Project, has also been reviewed.

This reporting period is effectively a full year of operation phase monitoring of CWDs. This annual report reviews the operation phase monitoring data for 2025 and compares it with the post-construction phase monitoring data for the previous years.

CWD monitoring was conducted by undertaking vessel line-transect surveys. The vessel line transects covered Northeast Lantau (NEL), Northwest Lantau (NWL), Airport West (AW), West Lantau (WL) and Southwest Lantau (SWL) at a frequency of two full surveys per month as proposed in Section 10.2.3.2 of the Updated EM&A Manual, which is consistent with the AFCD long-term monitoring programme (except AW). The locations of the CWD vessel survey transects are shown in **Figure 2.4**.

Additional survey effort was collected on a voluntary basis at the same frequency of two surveys per month from Deep Bay (DB) (refer to **Appendix E** for the location of this additional survey), which is an area that historically had CWDs in the outer bay, to establish a more comprehensive understanding of CWD distribution and abundance. All the DB data were considered supplemental and were only used for density and abundance estimation.

Density and abundance analysis made use of both conventional distance sampling (CDS) and a more sophisticated approach – multiple covariate distance sampling (MCDS) to estimate CWD abundance for the waters of Hong Kong. The additional analysis using MCDS is more time-consuming and labour-intensive than CDS as it uses information on environmental factors that are likely to affect detection probability (such as variables describing sighting conditions), but generally produces estimates with higher precision (i.e., lower variances and CVs) (Marques and Buckland, 2003 & 2004). However, datasets with small sample sizes (not unusual in marine mammal studies) can make it difficult or impossible to achieve model “convergence” in some MCDS analysis, and thus it is critical to always start each analysis with CDS methods (this also helps to determine the appropriate truncation distance and overall modelling approach).

Based on the vessel survey data, seasonal differences in dolphin density and use of the study area were examined, using the solar seasons (Winter: December-February, Spring: March-May, Summer: June-August, Autumn: September-November) and/or oceanographic seasons (Dry: October-March, Wet: April-September).

The travelling patterns in different areas were reviewed by using photo-identification of individual dolphins and their re-sighting locations, depicting the range use and cross-area movement of re-sighted individuals, where practicable.

2.5.1 Summary of Monitoring Results

2.5.1.1 Summary of Vessel Line-transect Survey Monitoring Results

2.5.1.1.1 Survey Effort

During the reporting period from January 2025 to December 2025, surveys were completed in NEL, NWL, AW, WL, and SWL survey areas. A total of around 5352.7 km survey effort was collected in this reporting period.

Around 97.2% (5201.5 km) of the survey effort was collected under favourable weather conditions (i.e. Beaufort 0-3 and visibility of approximately 1200 m or beyond), and can be utilised in analysis of encounter rates, density and abundance.

The breakdown of the survey effort by survey areas is tabulated in Table 1 of **Appendix E**. A detailed record of the survey effort data is also provided in **Appendix E**.

2.5.1.1.2 Sighting Distribution

During the reporting period, a total of 166 groups consisting of 466 CWDs were sighted in NWL, AW, WL and SWL survey areas. Among all these sightings, 165 groups with 464 CWDs were sighted during on-effort surveys under favourable weather conditions (Beaufort 0-3 and visibility of approximately 1200 m or beyond). The off-effort sightings were excluded from analysis in the following sections. Breakdown of the sightings by survey areas are tabulated in Table 2 of **Appendix E**, and the sighting locations of CWDs during this reporting period are depicted in Figure 1 of **Appendix E**.

In NWL (including AW transects), 11 CWD sightings were recorded, accounting for 7% of the total sightings. These sightings were mainly clustered at the western waters of the airport, along with a few sightings scattered around Sha Chau to the North of Lung Kwu Chau. Overall, there were more sightings recorded in NWL in 2025 than in 2024 (i.e. six sightings including AW transects).

In WL, 124 CWD sightings were recorded, accounting for 75% of the total sightings. CWD sightings were recorded on all transects and were distributed quite evenly over the entire survey area, particularly between Tai O and Fan Lau.

In SWL, 30 CWD sightings were recorded, accounting for 18% of the total sightings. Sightings of CWDs were scattered over the entire survey area in relatively coastal waters with more sightings located in the western end near Fan Lau.

No CWDs were recorded in NEL survey area.

2.5.1.1.3 Density and Abundance Estimation

Line-transect analysis to estimate the density and abundance of CWDs in Hong Kong waters during the reporting period was conducted using the same basic methods as in previous analysis (note that the changes in the size of the different survey areas over the past few decades have been taken into account in the line-transect analysis for this year, with the total area of the NWL area being reduced to account for this loss of potential habitat). Although it was experimented with Beaufort sea state as a co-variate, for 2025 the best estimate of abundance was obtained

using Conventional Distance Sampling and a half-normal model with a cosine adjustment (effective strip width = 185 m). The detection function of 3RS CWD monitoring data of this reporting period is shown in Figure 2 of **Appendix E** and the various parameters of the 2025 estimates are shown in Table 3 of **Appendix E**. The overall abundance estimated for this reporting period (incorporating an entire year of data from all four seasons) was 30 CWDs (CV = 19.4%, just below what is considered a good level of precision of <20%). This is lower than estimates from the last three years (i.e., 2022 to 2024). For comparison, 2024 estimate was 60 CWDs (CV = 21.9%), the 2023 estimate was 40 CWDs (CV= 14.4%), the 2022 estimate was 35 CWDs (CV = 15.8%). As in all recent years, the area with the highest abundance and density in 2025 was WL (N=24, D=72/100 km²; this has been consistent over the AFCD long-term records that WL has been the area with the highest CWD abundance and density). NWL showed similarly low numbers of dolphins from the previous year (1 in 2025 and 1 in 2024). SWL showed a decrease (from 15 to 5). The CWD densities in NWL and SWL were 2 and 7.5 individual(s) per 100km² respectively. NEL registered an abundance of zero, which has been the case in most of the last 10-12 years, observed from both AFCD's and 3RS's monitoring. The overall decrease in abundance estimated in 2025 should not be taken as an indication of a long-term trend. We appeared to be seeing the beginnings of a recovery since 2021 (after dolphins moved away from the 3RS works area in past years), and clearly we are not yet seeing signs of a strong recovery in numbers north of Lantau Island. The drop of CWD abundance in NWL since about 2010 is thought to be partly related to the impacts from the construction of the Hong-Kong-Zhuhai-Macao Bridge (HZMB) (Jefferson 2018 and Huang et al. 2024). The HZMB impacts on dolphins were expected between 2011-2016 during its construction phase, and in fact, this time period saw a significant drop in numbers of dolphins in Hong Kong (see Jefferson 2018; Jefferson et al. 2023). Huang et al. (2024) reported an increase of CWD abundance in Lower Lingding Bay (where majorly connected to WL and SWL) during 2020-21 (i.e. classified as post-construction phase of HZMB project by their study) which is aligned with the beginning of a potential recovery observed from 3RS monitoring results in 2021. Though this will require further examination, a generally increasing trend of CWD abundance since the completion of 3RS marine works in 2021 (despite the drop in 2025) is consistent with what was predicted in the 3RS EIA: that further drops in CWD numbers during the 3RS construction are expected, followed by a likely rebound towards pre-3RS construction levels in the period after completion of 3RS marine works and establishment of the North Lantau Marine Park (which came into effect in November 2024).

It is worth noting that the 3RS EIA predicted significant impacts on CWDs (Mott MacDonald 2014), and a drop in numbers of dolphins in the area during the most intensive part of the 3RS construction phase was expected. Reclamation filling works were substantially completed in 2021 and some recovery after the main marine filling and reclamation works finished was anticipated. However, the longer term rebound will need to be examined with more data over several years, as recovery may take some time, and fluctuations from year to year can be expected in the context of any overall trend. Cumulative impacts due to the 3RS Project with other concurrent projects (e.g., reclamation works near Tung Chung in recent years which was completed in Jan 2023, for instance) will become clearer as monitoring efforts continue.

In addition to estimating year-round abundance for each of the survey areas, a seasonal analysis was also conducted (the pooled dataset from all survey areas was used, as stratifying by both survey area and season would reduce the sample sizes that result in estimates with unacceptably low levels of precision) (refer to Table 3 of **Appendix E**). The spring estimate was the lowest (N=32 dolphins), with the summer estimate showing the highest numbers (N=37 dolphins). This is similar to past records of dolphin numbers in Hong Kong, where autumn or summer is usually the high season and spring the low season.

2.5.1.1.4 Quantitative Grid Analysis on Habitat Use

Quantitative grid analysis was conducted to examine the habitat use amongst the survey areas, both SPSE (no. of on-effort sightings per 100 units of survey effort) and DPSE (no. of dolphins

per 100 units of survey effort) values for each 1 km² grid were calculated in all grids amongst all survey areas for the period from January 2025 to December 2025. SPSE and DPSE of the current reporting year and the previous reporting years are depicted in Figure 3 of **Appendix E**.

There was an increase of CWDs' usage of waters in NWL in 2025 compared to the previous year, with more usage of waters around SCLKCMP and in the area to the west of HKIA. Although this observation does not imply a sustained population recovery, it is still a good sign of dolphin recovery in NWL and monitoring should be continued in coming years.

The important dolphin habitats in WL survey area in 2025 are similar to 2024. Grids with high SPSE and/or DPSE value(s) in WL were near Tai O, Yi O, Peaked Hill and Fan Lau.

In SWL, there was a decrease of CWDs' usage, reflected by both SPSE and DPSE, at the waters between Soko Islands and Lo Kei Wan and between Soko Islands and Fan Lau in 2025 after a mild rebound in 2024.

Cumulative SPSE and DPSE values were also calculated by using the 3RS CWD monitoring data since mid-December 2015 and are depicted in Figure 4 of **Appendix E**. Grids in western waters of Hong Kong with higher dolphin density are restricted to waters off West Lantau, at Tai O, Yi O, Peaked Hill and Fan Lau.

2.5.1.1.5 Group Size

During the reporting period from January 2025 to December 2025, group size of CWDs ranged from 1 to 15 dolphins, with an average of 2.81, based on all on-effort CWD sightings. The average group sizes of NWL, AW, WL and SWL were 2.22, 2.00, 2.81 and 3.07 respectively. By four solar seasons, the average group size of CWDs was the highest in autumn (3.38) but the lowest in spring (2.47). The summaries of the average group size of CWDs by survey area and by season are presented in Table 4 and Table 5 of **Appendix E**.

CWD sightings with small group size (i.e. 1 to 2 dolphins per group) were dominant in 2025 with around 59.4% all on-effort sightings. Three sightings, which accounted for 1.8% of all sightings, were large CWD groups with 10 or more dolphins per group.

Both small and medium CWD groups were generally sighted throughout the distribution range of dolphins in NWL, WL and SWL waters in 2025, except the observation that most sightings in the west of airport are in small-sized groups. Those three large-sized CWD groups were recorded in WL near Tai O, Peaked Hill and Fan Lau respectively. The sighting distribution of CWDs with different group sizes is illustrated in Figure 5 of **Appendix E**.

2.5.1.1.6 Activities and Association with Fishing Boats

Vessel surveys do not provide the most unbiased information on the behaviour and activities of dolphins, due to the potentially disturbing presence of the vessel itself, and also the low vantage point of small vessels. However, behaviour and activity data are useful in gauging where and how dolphins are spending their time, with short and longer term (inter-year) comparisons of potential changes and therefore continue to be collected from the vessel surveys.

During the reporting period, a total of 42, 14, 10 and 1 groups of CWDs were observed engaging in foraging, travelling, socialising and resting/milling activities, comprising of 25%, 8%, 6% and 1% of all on-effort CWD sightings respectively. The sighting locations of CWD groups engaged in different types of activities are depicted in Figure 6 of **Appendix E** while the percentages of different activities for each of the survey areas are shown in Table 6 of **Appendix E**.

In NWL, all foraging and resting/milling activities occurred at the west of the airport while a sighting with traveling activity was recorded within the SCLKCMP. The occurrence of foraging activities observed west of the airport may suggest that AAHK's recent habitat enhancement measures such as the deployment of artificial reefs (ARs) and shellfish reef (SRs) and also the

implementation of eco-enhanced seawalls and several rounds of fish restocking have contributed to improvements in local marine environmental conditions, thereby potentially increasing habitat suitability for CWDs in this area. Monitoring will continue and will help to indicate if there is any sustained recovery of CWDs in the area. In NWL, 33% of CWD sightings were engaged in feeding activity, which was slightly lower compared to the previous year (40% in 2024).

In WL, foraging, socialising and traveling activities of CWDs occurred throughout the entire survey area. No CWD sightings engaged in milling/resting activities was recorded in WL survey area. In WL, 23% of CWD sightings were engaged in feeding activity, which is slightly higher than the 21% recorded in 2024.

In SWL, the sightings with observed activities were clustered at the western water of the survey area, with a few sightings in the northern water of Soko Island. Travelling activities occurred near Fan Lau and the northern waters of Soko Island. Socializing activities in SWL only occurred at Fan Lau. About 33% of the CWD sightings in the survey area were engaged in feeding activity, which is slightly higher than that recorded in 2024 (i.e. 29%).

A total of 18 sightings of CWDs were observed associating with operating fishing boats, including gill netters (three groups), shrimp trawler (three groups) and purse seiners (12 groups), accounting for 10.9% of all on-effort sightings in 2025. CWDs' association with operating fishing boats in 2025 showed an increase compared to that of last year (6.6% in 2024). Although trawling is prohibited in Hong Kong waters, however, in most cases, the trawlers observed were operating along the waters of the HKSAR boundary.

Observations of CWD association with operating fishing boats were scattered in WL and SWL. In WL, association with gill netters, shrimp trawler and purse seiners scattered throughout the northern waters of Peaked Hill, with one observation of association with purse seiners recorded near Fan Lau. While in SWL, only associations with operating purse seiners were observed and all these records are located in waters around and Fan Lau and Kau Ling Chung. The sighting locations of CWD groups associated with operating fishing boats are depicted in Figure 7 of **Appendix E**.

2.5.1.1.7 Mother-calf / Mother-unspotted Juvenile Pairs

During the reporting period, a total of 28 sightings were observed with the presence of mother-and-unspotted calf (UC) and/or mother-and-unspotted juvenile (UJ), which accounted for about 17.0% of all on-effort sightings of 2025. The number of sightings with the presence of mother-calf pair(s), was higher than that of 2024 (25 sightings). This indicates that Hong Kong western waters continue to function as an important nursery area for CWDs and suggests that the habitat remains suitable for supporting the reproduction and early life-stage development of CWDs, which is a key prerequisite for any potential long-term recovery of CWD population in Hong Kong waters. The percentages of sightings with the presence of mother-calf pair(s) in WL and SWL were 16.9% and 23.3% respectively. These percentages were calculated by dividing the number of sightings with mother-calf pair(s) of a survey area by the total number of on-effort sightings of that survey area.

Amongst the abovementioned 28 sightings, five sightings were observed with the presence of mother-and-UC pair(s), 19 sightings were observed with the presence of mother-and-UJ pair(s) and four sightings were observed with the presence of both mother-and-UC and mother-and-UJ pairs. According to the results of photo-identification, a total of seven mother-calf pairs were successfully identified from these 28 sightings.

Most of the sightings with the presence of mother-calf pair(s) were recorded at the waters near Tai O, Peaked Hill, Fan Lau and Kau Ling Chung. The sighting distribution of mother-calf pairs is depicted in Figure 8 of **Appendix E**.

2.5.1.1.8 Photo Identification – Summary

In 2025, a total of 12 newly identified CWD individuals were added to the photo-identification catalogues, including two animals added to NL catalogue and 10 animals added to WL catalogue.

Ninety-eight individual CWDs were identified in 2025, with a total of 242 identification records, including multiple re-sightings of the same individuals. Amongst these 98 CWD individuals, 13, 65 and 20 belonged to NL, WL and SL catalogues respectively. There were 52 individuals (53.1%) that were sighted more than once. Twelve of these 52 re-sighted individuals were sighted five times or more.

The most frequently re-sighted individuals in 2025 were SLMM003 which was sighted 12 times, followed by WLMM114 which was sighted 10 times. SLMM003 was also one of the most frequently re-sighted individuals of the previous reporting year (i.e. being sighted for 11 times in both 2024 and 2023). It is also the most frequently re-sighted individual since the establishment of the photo-identification catalogue, which has been sighted 87 times, followed by SLMM014 (being sighted 83 times), and WLMM001 (being sighted 68 times). There are a few more individuals including NLMM013, NLMM023, WLMM003, WLMM007, WLMM027, WLMM028, WLMM029, WLMM043, WLMM056, WLMM063, WLMM065, WLMM067, WLMM071, WLMM073, WLMM079, WLMM114, WLMM131, SLMM002, SLMM007, SLMM010, SLMM012, SLMM022, SLMM023, SLMM025, SLMM027, SLMM031, SLMM037, SLMM044, SLMM049 and SLMM052, that have been sighted 30 times or more.

Forty-four individuals that appeared in Hong Kong waters in previous years (with 10 or more re-sighting records since the commencement of the monitoring in mid-December 2015) did not appear in our sighting records in 2025 (note that these dolphins may still be using Hong Kong waters but may have not been detected from our surveys). These individuals are NLMM001, NLMM002, NLMM004, NLMM006, NLMM009, NLMM010, NLMM015, NLMM016, NLMM018, NLMM019, NLMM020, NLMM021, NLMM039, NLMM041, NLMM043, NLMM052, SLMM011, SLMM012, SLMM015, SLMM017, SLMM028, SLMM029, SLMM037, SLMM044, SLMM045, SLMM053, SLMM058, SLMM059, WLMM006, WLMM008, WLMM013, WLMM019, WLMM030, WLMM054, WLMM060, WLMM062, WLMM076, WLMM078, WLMM081, WLMM086, WLMM090, WLMM107, WLMM131 and WLMM149. Some of these 44 individuals (i.e. NLMM002, NLMM004, NLMM006, NLMM010, NLMM018, NLMM019, NLMM043, SLMM011, SLMM012, SLMM015, SLMM017, SLMM028, SLMM045, SLMM053, WLMM006, WLMM013, WLMM054, WLMM060, WLMM076, WLMM078, WLMM081, WLMM090, WLMM107 and WLMM131) have not been seen in Hong Kong waters for three or more years. It could not be confirmed that if these animals were occurring elsewhere in mainland waters, or if some of them have already died.

In October 2025, a request from AFCD for seeking assistance in helping to monitor an individual dolphin which entangled in a rope, was received. This individual dolphin was found entangled in a rope in April 2024 by AFCD's monitoring team. Upon receipt of the request from AFCD, the photo-identification catalogue developed under the dolphin monitoring of 3RS project was carefully examined to extract information of this particular dolphin individual. This individual dolphin is WLMM043 which was first identified in July 2016 under the photo-identification catalogue of 3RS project and has been seen 52 times in total during the dolphin monitoring of 3RS project. MMHK's dolphin monitoring team first observed WLMM043 entangled with a rope on 7 August 2024. Based on the records and observation, WLMM043 looks normal after injury as it still showed foraging behaviour and its range use did not show any significant reduction. However, it was observed that the rope is getting deeper at its neck over time and it tended to appear alone or in smaller group after injury and the most concerning is that WLMM043 was not being encountered since the last record made in May 2025. There are plenty examples of dolphins recovering from injuries caused by entanglement with ropes or nets. Thus, continuous attention should be kept paying on WLMM043 during other on-going dolphin monitoring.

A summary of the photo-identification records of CWDs is presented in Table 7 of **Appendix E**.

2.5.1.1.9 Photo Identification – Range Use of Identified CWD individuals

SLMM003, the most frequently re-sighted animal in 2025 and also the most frequently re-sighted animal since mid-December 2015, continued to occur frequently in WL and SWL waters. Compared to 2024, SLMM003's northern end range use in 2025 shrank slightly from Tai O to Yi O, while its range use in WL and its eastern end range use in SWL remained similar.

WLMM114 is the 2nd most frequently re-sighted animal in 2025. It continued to occur frequently in WL and SWL waters. The extent of its range use remained relatively the same compared to 2024, covering from Tai O to the waters between Fan Lau Tung Wan and Shek Pik.

SLMM014, the 2nd most frequently re-sighted animal since the establishment of the photo-identification catalogue, continued to frequently utilize WL and SWL waters. Continuing from the last two years, the northern end of SLMM014's range use in WL further shrank from Peaked Hill to Fan Lau. When compared with earlier years from 2015 to 2023, SLMM014's range in Hong Kong waters showed a distinct reduction from the west of the HKIA in north Lantau to Shui Hau in south Lantau in earlier years, to the coastal waters between Fan Lau and Shek Pik. Such a reduction in mobility particularly in the past few years may arise from age-related factors, accumulated stress, or subtle physical or behavioural limitations that are not directly observable during vessel surveys, given that the environmental conditions remain broadly unchanged suitable in these few years based on field observation. Continued attention shall be paid will be on SLMM014's reduced mobility.

The sighting locations of SLMM003, SLMM014 and WLMM114 are depicted in location maps under Figure 9 of **Appendix E**, which provide the indicative distribution range use of representative individuals recorded from the 3RS CWD monitoring.

2.5.1.1.10 Photo Identification – Cross-area Movement

Amongst the 52 individuals that were re-sighted more than once in in 2025 31 individuals showed cross-area movement between survey areas. This accounted for about 31.6% of all 98 identified CWD individuals in 2025. Amongst these 31 individuals, 4 (16.7%) were re-sighted in both NWL (including AW) and WL, 27 individuals (87.1%) were recorded in both WL and SWL. There was 1 individual, namely WLMM065, recorded occurring in all three main survey areas (WL, SWL and NWL) in 2025. The sighting locations of WLMM065 are depicted in a location map under Figure 9 of **Appendix E**.

2.5.1.1.11 Photo Identification – Residency Pattern

The residency patterns of the dolphin individuals identified under this monitoring programme have been examined. For residency pattern analysis, both seasonal and annual occurrence patterns of identified CWD individuals with 15 or more re-sighting records (since the establishment of the photo-identification database) were carefully examined. "Residents" are defined as individual dolphins that were regularly sighted for at least three consecutive years, while "Visitors" are individuals that were intermittently sighted during the past years since the establishment of the photo-identification database. Seasonal occurrence patterns were also examined to distinguish individuals that occurred year-round (i.e. individual dolphins sighted in all four seasons of a year in at least one of the last two years) or seasonally (i.e. individual dolphins that occurred only in certain season(s) of a year). Therefore, there are four combined classifications of the residency pattern of an individual dolphin theoretically. These four classifications are:

"Year-round resident" – dolphin which appears in Hong Kong waters in all four seasons of a year in at least one of the two last years and it was sighted for at least three consecutive years

"Seasonal resident" – dolphin which appears in Hong Kong waters only in certain season(s) of a year and it was sighted for at least three consecutive years

“Year-round visitor” – dolphin which appears in Hong Kong waters in four seasons of a year in at least one of the two last years and it was NOT sighted for at least three consecutive years

“Seasonal visitor” – dolphin which appears in Hong Kong waters only in certain season(s) of a year and it was NOT sighted for at least three consecutive years

Up to year 2025, photo-identification records of 73 dolphin individuals that have at least 15 re-sightings since the establishment of the database were examined. There are 9 individuals namely SLMM002, SLMM003, SLMM007, SLMM014, SLMM023, SLMM073, WLMM067, WLMM079 and WLMM114 being defined as year-round residents. Thirty-three individuals were considered as seasonal residents. Thirty-one individuals are considered as seasonal visitors to Hong Kong waters. Details of the residency pattern of these 73 animals are shown in **Appendix E**.

2.5.2 Discussion on CWD Monitoring Results

CWD monitoring by vessel surveys has been conducted as required during the construction phase from 2015 to 2023 and post-construction phase in 2024, with substantive marine works largely completed since 2021. The 12 months operation phase monitoring was completed between January and December 2025.

Vessel Line-transect Survey

From the CWD vessel-based monitoring data, the estimate of overall abundance for 2025 was 30 dolphins, which is considerably lower than the 60 dolphins the year before, with a CV of 19.4% (which indicates a good level of precision). This lower estimate is in contrast to the generally increasing trend observed between 2021 and 2024. When reviewing these abundance estimates, It is important to note that the number of sightings/dolphins is only one component of the abundance estimate using line-transect distance sampling method. Other components include: survey effort under different weather conditions, group size of the sightings, distance of the sightings to the transects (i.e. Perpendicular Sighting Distance PSD) and detection probability. These components are influenced by many factors, such as dolphin behaviour (dolphins may change their behaviour or distribution, making them less or more visible during the survey), and environmental and survey conditions (e.g., water, weather, and sea conditions, food availability, or human activities that all influence dolphin visibility and distribution). The lower abundance estimate in 2025 is consistent with a relatively large reduction in average group size (2.2 in 2025 compared to 3.1 in 2024, calculated from distance analysis, refer to Table 3 of **Appendix E**), which scaled down the estimated abundance in distance analysis, even when the total number of dolphins observed during vessel-survey is similar between the two years.

While the estimate of total dolphin numbers in 2025 was lower than the previous year’s estimate, a change from one year to the next should never be taken as an indication of long-term trends. The seasonal analysis showed that during all four seasons, dolphins are present in the study area in approximately equal numbers. The 2025 seasonal range is 32 in Spring to 37 in Summer, but it was significantly lower than the summer influx of CWDs in 2024 where the summer estimate was 104 dolphins. The pronounced reduction in abundance estimates for CWDs in 2025 particularly during summer coincided with an exceptionally active stormy tropical-cyclone year in Hong Kong. Compared with 7 tropical cyclones affecting Hong Kong in 2024, a record of 14 tropical cyclones, including 5 super typhoons, affected the territory in 2025. In addition, while no Black Rainstorm Warning and 4 Red Rainstorm Warnings were issued in 2024, 2025 saw a record-breaking 5 Black Rainstorm Warnings and 16 Red Rainstorm Warnings, particularly during June to September. Intense and frequent storm events are known to substantially alter coastal environmental conditions, including increases in turbidity, freshwater input, and water-column mixing, as well as persistent overcast condition and prolonged periods of elevated sea state before and after typhoon passage. For coastal delphinids such as CWDs, these conditions can

alter their distribution and behaviour (such as surfacing and grouping), and visual detectability, even during surveys conducted under nominally acceptable Beaufort sea states (Parson, 2004).

Despite a marked reduction in estimated abundance in 2025, the number of CWDs recorded during vessel surveys was comparable to 2024 (466 dolphins in 2025 vs. 490 dolphins in 2024). The exceptionally stormy conditions in 2025 may have influenced dolphin behaviour and distribution and altered detectability of CWDs. Substantially smaller average group size calculated from distance analysis were observed in 2025 compared to 2024, which potentially lead to a lower abundance estimate. This suggests that the lower abundance estimate in 2025 could reflect an inter-annual fluctuation due to short-term behavioural responses to predominant extreme weather conditions rather than a true decline in population size.

Although CWD estimates in Hong Kong were relatively stable or increased somewhat from 2016 to 2018 (Jefferson 2018; Jefferson et al. 2023; 3RS Annual EM&A Report 2018), Hong Kong waters have been showing an overall declining trend in dolphin numbers over much of the last two decades or so (see Jefferson 2018; Jefferson et al. 2023), and the 3RS EIA predicted shifting of dolphins away to waters outside Hong Kong and a significant effect on numbers in Hong Kong during intensive periods of construction (EIA Report Section 13.9.2). From 2018-2021, there was seawall construction and marine filling in the 3RS works area, as well as reclamation works for the Tung Chung New Town Extension concurrently in North Lantau waters. Since the major reclamation work for the 3RS Project concluded in 2021, some level of recovery would be expected, and some early signs of that appear to be evident in the data (despite the drop in numbers in 2025). However, several additional years of similar survey effort will be needed to examine this issue thoroughly, and we should not yet conclude that recovery has begun (nor that it has stopped). In fact, some time delay in seeing an increase in dolphin numbers would be reasonable to expect, and fluctuations in dolphin numbers appear to be a normal part of the recovery process. In particular, significant recovery would not be expected until sometime after the NLMP came into effect, which happened in late 2024.

Within NWL waters, CWDs have recently been mostly found in the western waters of the airport Island. The main concern is that dolphin numbers in NWL have decreased quite significantly in the past two decades, from around 100 to less than 10 (see Jefferson 2018; Jefferson et al. 2023). Some good news is that generally in WL and SWL dolphin numbers have remained similar to or above those in previous years and there are more sightings in NWL in 2025 compared to 2024. Past decreases suggested that construction activities in other areas of western Hong Kong waters (which, besides the 3RS works, includes IWMF works at Shek Kwu Chau) and other factors that are affecting dolphins north of Lantau Island may also be affecting their use of the waters south and west of Lantau Island. The potential for cumulative and far-ranging impacts from projects in specific areas is not well understood and should be a focus of future monitoring efforts covering broader Hong Kong waters and further afield. This would be a particularly acute concern for WL, which is known to represent the highest-density area for CWDs (and has been the highest since monitoring efforts began in the mid-1990s) and although not heavily impacted by marine construction in the past few years, the area has nonetheless shown evidence of a decrease in CWD numbers between 2019 and 2022, followed by a rebound in 2023 and 2024. The cause of this decline is not yet understood, and although there is a rebound during some of the recent years, the abundance of CWDs in WL survey area should be closely monitored.

In earlier years, concerns had been expressed by some stakeholders that dolphin numbers in NWL may have decreased due to hypothesized negative impacts from the re-routing of high-speed ferries (HSFs) to the Speed Control Zone (SCZ) north of Lung Kwu Chau. The analysis covering the entire first year post-SCZ (2016) provided an estimated abundance of 15 dolphins for NWL (refer to the 2016 annual report). The estimate for 2017 for the same area was 14 dolphins. The 2018 estimate was substantially higher at 22 dolphins. Therefore, the drop in 2019 to 8 dolphins was not likely due to the effects of the SCZ, which had been in operation for several

years, but was more likely due to relatively more construction works for the 3RS and concurrent activities (such as changes in overall vessel traffic) in NL waters, or due to other unknown reasons. This belief is further bolstered by the fact that daily HSF trips were down substantially to single-digits in 2020 to 2022, due to COVID-19 impacts, and yet CWD numbers continued to decrease. Whatever the reasons for the fluctuations in numbers of dolphins in the NWL area, there is still no evidence that the SCZ has had any negative impacts on the dolphins.

Concerns were expressed in the 3RS EIA about the potential impacts on the travel corridor/area between both the 3RS project Area and SCLKCMP, and between CWD hotspots in NWL, NEL and WL, and the concern on the effectiveness of implementing the SkyPier HSF route diversion in alleviating the impacts on CWD travelling areas. Increased CWD sightings from vessel surveys in NEL area during 2018 suggested that a slight rebound in the use of these travel areas by CWDs may have occurred; however, this increase did not continue in 2019-2025. HZMB impacts were likely most severe during the period from 2013 to 2016 when construction works were ongoing (a period which saw an overall decline in CWD numbers in Hong Kong – Jefferson 2018), and the increase in CWD numbers in 2018 may have been the initial stages of recovery from that period of more intensive HZMB construction impacts. It is likely that the 3RS construction works and other concurrent activities in NL waters in 2019 onwards may have caused dolphins to again move away from these areas, as predicted in the 3RS EIA (Section 13.9.2). Nevertheless, it is noted that previous experience suggests that when construction is completed, and now that the new marine park has gone into effect, a rebound in numbers can again be expected (see Jefferson 2018). Data since 2018 indicate that the travelling areas are still being used, although at a lower level. It should also be kept in mind that dolphins tend to move through these areas relatively quickly and do not generally spend as much time milling as they do in the main foraging/socialising areas, which may further reduce the chance of dolphin sightings.

Photo-identification

Regarding the results of photo-identification work, a total of 98 CWD individuals were identified for altogether 242 times from all sightings in 2025, with 52 individuals (around 53.1%) sighted more than once. Amongst the 52 individuals that were re-sighted more than once in 2025, 31 individuals showed cross-area movement between survey areas. This accounted for about 31.6% of all 98 identified individuals in 2025. There were dolphins showing cross-area movement either between NWL-WL and WL-SWL but none showing cross-area movement between NWL-SWL except one individual namely WLMM065 which occurred in all three main survey areas (WL, SWL and NWL) in 2025. After a remarkable increase in cross-area movement involving NWL from eight individuals in 2020 to 21 individuals in 2021 followed by a drop to 12 individuals in 2022, the number of identified individuals with cross-area movement involving NWL slightly increased to 15 individuals in 2023. However, such increase did not continue in 2024 (six individuals) and dropped slightly to five individuals in 2025. The most frequently re-sighted animals in 2025 were SLMM003 which was sighted 12 times, followed by WLMM114 which was re-sighted 10 times. Nine identified dolphins were considered as year-round residents of Hong Kong waters in view of their occurrence pattern in all seasons for recent consecutive years.

Moreover, approximately 100 CWD individuals were successfully identified each year in Hong Kong's western waters in the past five years between 2021 and 2025, with annual totals ranging from 98 to 116 individuals. In addition, between 12 and 18 newly identified individuals were added to the photo-identification catalogue each year. These results indicate that Hong Kong's western waters continue to be regularly used by a substantial number of dolphins, with over 100 individuals recorded annually as part of their home ranges during the past five years. The continuous recruitment of newly identified individuals also suggests ongoing exchange and connectivity with the broader Pearl River Estuary population. During the same period, 24 to 29 sightings of mother–calf pair(s) were recorded annually, indicating that Hong Kong's waters continue to serve as

important nursery habitat for the species, supporting both calf rearing and recruitment within the wider Pearl River Estuary population.

Voluntary Supplementary Surveys by Passive Acoustic Monitoring

For better analysis of any rebound/changes of CWDs using the waters around the 3RS Project area, AAHK initiated the conduct of rebound surveys by means of PAM since 2020 to acquire extra CWD data. The Rebound Surveys were conducted by deployment of PAM devices called F-PODs, at seven locations around the waters of AW, SCLKCMP, BMP and NLMP (see Figure 1 of **Appendix E.1**). The Rebound Survey results indicated an overall increasing trend in dolphin acoustic detections in NWL waters from 2023 to 2025 after the completion of 3RS reclamation and marine works (Figure 2 of **Appendix E.1**), providing supplementary evidence that CWD usage in this area may be higher than suggested by vessel-based abundance estimates alone.

As presented in Figure 3 of **Appendix E.1**, a notable increase in detections was recorded at the two locations in Airport West waters in 2025 (i.e. Location C and Location E), with overall mean daily DPM² of 14.2, overall DPD%³ of 70%, indicating the continued use of the western waters of HKIA by CWDs. Meanwhile, detections at the three locations near Sha Chau waters (i.e. Locations A, D and A5) declined sharply in 2023, followed by a slight downward trend in subsequent years. Despite this reduction, dolphin DPM in Sha Chau waters remained relatively high. In addition, two potential overlapping acoustic events and vessel survey sightings were recorded in NWL, further supporting the presence of sustained dolphin activity in this area. In contrast, relatively low levels of acoustic activity were observed at the two stations in Airport East waters throughout the period from 2022 to 2025.

Overall, the dolphin DPM recorded in winter was the highest among all solar seasons, accounting for around 55% of the total dolphin DPM of Year 2025.

As shown in the Figure 4 of **Appendix E.1**, The Rebound Survey also revealed a pronounced diel pattern, with peak dolphin detections occurring predominantly during night-time hours (e.g. approximately 42% detections in Year 2025 were recorded between 19:00 and 00:00; while 37% detections were recorded between 01:00 and 08:00), highlighting an important limitation of conventional vessel surveys, which restricted to daytime periods that allows visual observations. As such, vessel-based monitoring under the 3RS EM&A programme may underestimate actual CWD usage in NWL, particularly during periods when dolphins' nocturnal activity is pronounced.

Supplementary Information on CWDs Observations

Eco-tours organised by AAHK between May 2025 and March 2026 provide a source of supplementary information on CWD activity. The eco-tours recorded 305 dolphins in a total of 35 trips in waters west of the airport and off West Lantau, in which there were seven sightings made in waters west of the airport and to the north of HZMB. These figures represent the total number of encountered dolphins and may include repeated individuals. Among the 305 dolphins sighted, 20 were calves (including UC and UJ). While these observations are derived from non-systematic survey effort and are therefore not directly comparable with vessel-based monitoring data, they provide supplementary evidence that CWDs continue to utilise western Hong Kong waters including west of the HKIA in NWL.

² DPM = detection positive minutes (minutes with one or more dolphin detection)
Mean daily DPM = DPM / total logged days
Overall mean daily DPM of multi-Locations = Sum of mean daily DPM at each Location

³ DPD = detection positive days (days with one or more dolphin detections);
For generating the overall DPD for multi-Locations, when more than one Location recorded DPD on the same day, it counts **ONE** DPD for the day;
"DPD%" is the detection positive days as a percentage of total logged days.

2.5.3 Conclusions of CWD Monitoring Results

With reference to the aims of operation phase CWD monitoring described in the EM&A Manual (Section 10.2.1.2-4), the key findings of CWD monitoring in 2025 are summarised as follows.

Effects on the Potential Shift in CWD Travelling Areas and Habitat Use

The last few years of monitoring data indicate an increase in overall CWD population, but mixed trends in use of areas within Hong Kong waters in 2024 and 2025, as compared to the previous years. The main area of increased use was West Lantau, which showed a substantial increase from the previous years, but a decrease in 2025. SWL also showed an increase from 5 to 15, and then a decrease in 2025. In contrast, CWD abundance in North Lantau waters (i.e., NWL and NEL survey area) remained consistently low (e.g. approximately 1 individual) in recent years (2023–2025), with no evident rebound in the areas observed in 2025 despite the designation of the NLMP in late 2024. As expected and predicted in the 3RS EIA, dolphins likely shifted their activities away from the 3RS construction activities as well as the increasing marine works for the Tung Chung New Town Extension project in 2019-2021. Nevertheless, they still used Hong Kong's western waters (primarily SWL and WL) for important ecological activities such as foraging and resting, despite the disturbance. Whether a possible increase observed from 2021-2024 indicates the beginning of a long-term dolphin recovery in Hong Kong awaits more years of similarly-gathered data.

Effectiveness of the HSF Speed and Routing Restrictions to the CWDs

There are 10 years of data from the period since the SCZ was implemented, and the information available from both the vessel-based and the past land-based monitoring indicates that dolphin use of the NWL area has fluctuated from year to year (ranging from 1 to 22 dolphins), with a period of initial increase after the SCZ was put into effect. Due to COVID-19 effects, 2020, 2021 and 2022 were years of significantly decreased HSF activity in general, including in the SCZ area, and yet there was still a reduction in the use of NWL. Therefore, the evidence suggests that the SCZ is not impacting dolphin use of this area, and at the same time, is likely reducing the chances of dolphins being hit by vessels travelling at high speed. Daily SkyPier HSF trips resumed in 2023 and 2024 (refer to Section 2.9 and Table 2.19), while the dolphin abundance in NWL fluctuated between 2022 and 2024. Observations in 2024-2025 are still in line with those previous assessments.

Waters around Lung Kwu Chau have historically been a significant year-round habitat, especially for foraging, though 2020 saw a very large decline in use of this area by CWDs. There is no evidence that the observed decline in dolphin use of the HSF SCZ around Lung Kwu Chau was due to ferries being re-routed to that area with slower speeds at the end of 2015. The decline in numbers of dolphins in NWL area is not considered to be linked to HSF re-routings and the SCZ.

Trends in Long Term Monitoring Data

Based on vessel surveys conducted between 2020 and 2025, the estimated overall abundance of CWDs in Hong Kong waters was 32, 34, 35, 40, 60 and 30 individuals, respectively. These data indicate a gradual increase in abundance between 2021 and 2024, followed by a decline in 2025. Despite the increase observed in recent years, CWD use of Hong Kong waters remains substantially lower than levels recorded in the early 2000s.

Given the long lifespan and low reproductive rate of CWDs, short-term fluctuations in abundance, such as the decline observed in 2025 following higher values in preceding years, are likely to reflect inter-annual variation in distribution or response to environmental conditions (in this case potentially affected by the active stormy tropical-cyclone year in Hong Kong in 2025) rather than true population-level change. It should be noted that abundance estimates of CWDs in Hong Kong waters have historically shown considerable inter-annual variability since the early 2000s.

Continued long-term monitoring using consistent methodologies is therefore essential to determine whether the recent increase represents a sustained recovery trend or natural variability in habitat use over time.

West Lantau waters are still being used as the most important habitat in Hong Kong, as has been the case since CWD monitoring in Hong Kong started in 1995/1996. The increase of CWDs abundance in NWL in 2023 did not continue in 2024 or 2025. The low CWD abundance in NWL in 2024 and 2025 should not be interpreted as evidence of any long-term trend in NWL, as the overall dolphin abundance in Hong Kong waters has gone up considerably through 2024 and the supplementary information from Passive Acoustic Monitoring (PAM) findings exhibited more dolphin acoustic activities in NWL area in 2024 and 2025 compared with 2023.

While CWD abundance estimates derived from vessel surveys in NWL increased between 2020 and 2023 (estimated at 1, 4, 3 and 4 individuals respectively), a decline was recorded in 2024 and 2025 (with abundance estimated at 1 in both years). In contrast, PAM findings in 2025 exhibited an overall increasing trend in dolphin acoustic activity compared with 2023 and 2024, with detection levels remaining similar or slightly elevated across most PAM stations. This apparent discrepancy suggests that dolphins may have continued to use North Lantau waters on a regular basis despite lower abundance estimates derived from daytime surveys. Compared with previous years, increases in acoustic activity suggests a possible rebound or redistribution of CWD presence within North Lantau waters following the operation of the 3RS and the designation of the NLMP.

Recommendations on Future Monitoring for CWD Distribution

Taken together, the PAM results showing overall increasing detection of dolphin activities in NWL since 2024 with a marked diel pattern in night-time, provide indirect but independent evidence that the apparently low CWD abundance estimated for NWL in 2024-2025 calculated solely based on visual line-transect data from day-time vessel surveys should be interpreted with caution. Continuous and integrated monitoring during the 3RS operation phase, particularly combining vessel-based surveys with PAM, remains essential to elucidate longer-term recovery trends and habitat use patterns of CWDs in North Lantau waters, where the NLMP and other marine ecology enhancement measures have been implemented.

Theodolite tracking data will not be gathered in the immediate future due to the low detection rates of CWDs by this monitoring method, resulting in a lack of adequate survey data for conducting a robust analysis. Thus, no assessment of CWD behaviour or fine-scale movement patterns in the waters north of LKC, which historically supports high levels of dolphin activity, are possible. Should there be an increase in numbers in these former theodolite tracking areas, particularly north off LKC, such observations from shore may be re-initiated by AAHK to facilitate important long-term comparisons of behavioural data, including further information on dolphin reactions to human activities (Piwetz et al. 2015; Würsig et al. 2016).

It is important to remember that dolphins shift around within their habitat from year to year, due to both natural and anthropogenic factors. Thus, short-term monitoring data of CWDs is insufficient to indicate the full picture of population decline or recovery. Dolphins live for many decades and thus long-term monitoring using consistent methods is needed over an extended period of time in order to evaluate the true conservation status of the CWD population and how its use of Hong Kong waters is being affected over time.

The CWD construction, post-construction phase and operation phase monitoring data so far appear to be generally consistent with findings of the ecological assessments completed during the 3RS EIA, which predicted significant negative impacts during construction, including from the physical loss of habitat due to the reclamation (EIA Report Section 13.9.1). No unexpected

ecological impacts on CWDs have been identified, and the increase in abundance in 2021-2024 is encouraging (notwithstanding the decrease in 2025).

In the 3RS EIA and as reported in the last several Annual EM&A Reports, it was predicted that dolphins would shift away from portions of their home range experiencing intense human activities, and that appears to have been the case in 2020 when the estimated CWD abundance by 3RS construction phase CWD monitoring reached a low point (i.e. 32 dolphins) as seawall works and marine filling activities intensified. These impacts are anthropogenic disturbances and therefore are of conservation concern; however, they are likely temporary and reversible and previous studies have supported that dolphin numbers can be expected to recover over the long-term, after completion of works (assuming that the habitat is properly protected and still of adequate quality – Jefferson 2018). While the 2025 abundance estimate has again fallen, it is quite likely this reflects inter-annual variation. Operation phase CWD monitoring for the 3RS by vessel-based line transect method was completed in December 2025 (after the designation of NLMP in late 2024), with AAHK's voluntary CWD monitoring, including vessel survey and Rebound Survey continued in 2026 with focus on the North Lantau waters until around 2030 to monitor the trends in dolphin abundance and distribution over this longer period. The Rebound Survey is an additional AAHK initiative for CWD monitoring beyond statutory requirements and this monitoring effort is expected to facilitate an evaluation of impacts over time and will help determine if the Hong Kong CWD population stabilizes or increases in abundance in the future. An increase in numbers of Hong Kong CWDs is desirable for the long-term health of this population.

At this stage of the 3RS Project, all recommended mitigation measures have been implemented and although impacts were expected and have occurred, these appear to be temporary and within previously predicted patterns. As land formation was completed in the first quarter of 2023, and the NLMP was designated and came into effect on 1 November 2024, the expectation is that the CWD population will stabilize or increase in the coming years. Patterns of CWD abundance will be kept under review over the next few years, as AA's CWD Rebound Survey monitoring continues in the future.

Although abundance estimates derived from line-transect surveys in Hong Kong waters are typically used as an indicator of local population status, it is important to recognize that the dolphins occurring in Hong Kong represent only a portion of the much larger Pearl River Estuary (PRE) population. Current understanding suggests that the PRE population comprises approximately 2,000 individuals distributed across a broad geographic range extending through the waters of Hong Kong, Macao, Zhuhai and the western coast of the Guangdong Province. Other photo-identification and movement studies have demonstrated that many individuals regularly move across administrative boundaries and utilize habitats both inside and outside Hong Kong waters (Chen et al, 2010, Hung and Jefferson, 2004). Consequently, fluctuations in dolphin abundance recorded within Hong Kong may not necessarily reflect equivalent changes in the size of the entire PRE population, as local changes can also result from shifts in habitat use, ranging patterns, and distribution. Hong Kong therefore forms an important component of the Eastern PRE subpopulation but should be viewed within the broader context of the interconnected PRE metapopulation when evaluating population status and long-term conservation outcomes.

International Cetacean Expert's Observation and Recommendations from the 3RS Project Long-term Monitoring Effort

In terms of the long-term conservation and management of the CWD population and specifically that portion that uses Hong Kong waters, it is important for numbers to stabilize now that marine construction has completed, as the evidence suggests both that dolphins are using Hong Kong waters less intensively and that the overall population is declining (see Huang et al. 2012; Jefferson 2018; Jefferson et al. 2023). The intensive evaluation of construction methods that was undertaken in the EIA process for this project leading to lower impact construction approaches

and methods that are less harmful to dolphins, including the use of Deep Cement Mixing for site stabilization should be seen as an exemplary approach to be emulated and amplified in future impact assessments and on any future large projects in Hong Kong.

A major goal for Hong Kong (primarily the Agriculture, Fisheries and Conservation Department) and Mainland Management Authorities should be to establish effective measures including, but not limited to, protection of critical foraging and breeding habitat, as well as important travel routes for the dolphins. Most importantly, the area along the entire west coast of Lantau Island has consistently been used as prime habitat by CWDs for the past several decades, but unfortunately numbers there have declined between 2019 and 2022 (and again in 2025). This region has been confirmed by the current 3RS project monitoring efforts to remain as the most important habitat for dolphins in Hong Kong, based on densities of CWD use. This has also been confirmed by the recent computer modelling study of dolphin habitat in Hong Kong (Jefferson et al. 2023), but most of the area still remains unprotected, with the exception of the Southwest Lantau Marine Park, which was designated in 2020. The formation of Marine Parks/ Reserves for CWDs in this area should be seen as an extremely high priority for protecting critical dolphin habitat for the future of CWDs in Hong Kong. If it is used properly, the knowledge learned from the 3RS Project, as well as the funding support and attention given the CWDs from this project (e.g., through the Marine Ecology Enhancement Fund), can be very helpful for management authorities in achieving the important long-term goal of stabilizing the CWD population, and ensuring its long-term health and survival.

2.5.4 Site Audit for CWD-related Mitigation Measures

During the reporting period, teams of at least two dolphin observers were deployed by contractors for continuous monitoring of the Dolphin Exclusion Zone (DEZ) for armour rock laying works in accordance with the DEZ Plan from May to December 2025. No dolphins or other marine mammals were observed within the DEZs during this period. These contractors' records were audited by the ET during site inspections.

According to Section 10.6.2.2 of the Updated EM&A Manual, audits of HSFs implementation measures and Spill Response Plan implementation measures were conducted once every three months and every six months respectively for one year upon operation of 3RS.

For HSFs implementation measures, the first audit was conducted in February 2025, followed by subsequent audits in May, August and November 2025.

For Spill Response Plan implementation measures, the first audit was conducted in May 2025 and the second audit was conducted in November 2025.

The one-year audit for both HSFs implementation measures and Spill Response Plan implementation measures has been completed, with no specific findings identified throughout the audit period.

2.6 Sewage Flow Monitoring

In accordance with Section 6.2.1.1 of the Manual, the annual sewage flow monitoring commenced in June 2021, with the objective of informing the timing for initial planning of sewer upgrading works. Given that AAHK has begun planning for construction phase, the annual monitoring was concluded in December 2022. Details of the daily average flows data are presented in Annual EM&A Report No. 7.

In accordance with Section 6.2.1.2 of the Manual, the routine monitoring of hydrogen sulphide (H₂S) levels for the sewerage system of 3RS commenced after the commissioning of the 3RS on 28 November 2024.

2.7 Landscape and Visual Mitigation Measures

Implementation of applicable landscape and visual mitigation measures (reference to the environmental protection measures CM1 – CM10 in **Appendix C**) was monitored in accordance with the Manual and the Landscape & Visual Plan. All measures undertaken by both the contractor and the landscape contractor during the construction phase and first year of the operation phase are audited by a landscape architect, as a member of the ET, on a regular basis to ensure compliance with the intended aims of the measures.

Site inspections and audits are undertaken as necessary in the construction and operation phases in accordance with the Monitoring Programme for Landscape and Visual as shown in **Table 2.12**. In case of non-conformity, specific recommendations will be made, and actions will be proposed in accordance with the Event and Action Plan as shown in **Table 2.13**. No non-conformities were recorded during the reporting period.

Table 2.12: Monitoring Programme for Landscape and Visual

Stage	Monitoring Task	Monitoring Report	Form of Approval	Frequency
Detailed Design	Checking of design works against the recommendations of the landscape and visual impact assessments within the EIA shall be undertaken during detailed design and tender stage, to ensure that they fulfil the intention of the mitigation measures. Any changes to the design, including design changes on site shall also be checked.	Report by AAHK / PM confirming that the design conforms to requirements of EP.	Approved by Client	At the end of the Detailed Design Phase
Construction	Checking of the contractor's operations during the construction period.	Report on Contractor's compliance, by ET	Counter signature of report by IEC	Weekly
Establishment Works	Checking of the planting works during the twelve-month Establishment Period after completion of each batch of transplanting works.	Report on Contractor's compliance, by ET	Counter signature of report by IEC	Every two months
Long Term Management (10 year)	Monitoring of the long-term management of the planting works in the period up to 10 years after completion of each batch of transplanting works.	Report on Compliance by ET or Maintenance Agency as appropriate	Counter signature of report by Management Agency	Annually

Table 2.13: Event and Action Plan for Landscape and Visual

Event Action Level	Action			
	ET	IEC	AAHK / PM	Contractor
Design Check	Check final design conforms to the requirements of EP and prepare report.	Check report. Recommend remedial design if necessary.	Undertake remedial design if necessary.	
Non-conformity on one occasion	Identify source. Inform IEC and AAHK / PM. Discuss remedial actions with IEC, AAHK / PM and Contractor.	Check report. Check Contractor's working method. Discuss with ET and Contractor on possible remedial measures.	Notify Contractor. Ensure remedial measures are properly implemented.	Amend working methods to prevent recurrence of non-conformity. Rectify damage and undertake additional action necessary.

Event Action Level	Action			
	Monitor remedial actions until rectification has been completed.	Advise AAHK / PM on effectiveness of proposed remedial measures. Check implementation of remedial measures.		
Repeated Non-conformity	Identify source.	Check monitoring report.	Notify Contractor.	Amend working methods to prevent recurrence of non-conformity.
	Inform IEC and AAHK / PM.	Check Contractor's working method.	Ensure remedial measures area properly implemented.	Rectify damage and undertake additional action necessary.
	Increase monitoring frequency.	Discuss with ET and Contractor on possible remedial measures.		
	Discuss remedial actions with IEC, AAHK / PM and Contractor.	Advise AAHK / PM on effectiveness of proposed remedial measures.		
	Monitor remedial actions until rectification has been completed.	Supervise implementation of remedial measures.		
	If non-conformity stops, cease additional monitoring.			

Note:

For PM in **Table 2.13**, refers to Project Manager only.

2.7.1 The Implementation Status of the Environmental Protection Measures

The implementation status of the environmental protection measures is summarised below in **Table 2.14**. For trees which were managed by the Project during the reporting period, relevant measures have been implemented by Contracts 3508 and the works of 132kV Cable.

Table 2.14: Implementation Status of the Environmental Protection Measures

Landscape and Visual Mitigation Measures during Construction	Implementation Status	Relevant Contract(s) in the Reporting Period
Implementation Status		
CM1- The construction area and contractor's temporary works areas shall be minimised to avoid impacts on adjacent landscape	The implementation of mitigation measures was checked by ET during weekly site inspection and clarified by the Contractors during the monthly Environmental Management Meetings. Implementation of the measures CM5, CM6 and CM7 by Contractors was observed.	All works contracts
CM2 – Reduction of construction period to practical minimum		
CM3 – Phasing of the construction stage to reduce visual impacts during the construction phase		
CM4 – Construction traffic (land and sea) including construction plants, construction vessels and barges shall be kept to a practical minimum		
CM5 – Erection of decorative mesh screens or construction hoardings around works areas in visually unobtrusive colours		

Landscape and Visual Mitigation Measures during Construction	Implementation Status	Relevant Contract(s) in the Reporting Period
CM6 – Avoidance of excessive height and bulk of site buildings and structures		
CM7 – Control of night-time lighting by hooding all lights and through minimisation of night working periods		
CM8 – All existing trees shall be carefully protected during construction. Detailed Tree Protection Specification shall be provided in the Contract Specification. Under this specification, the Contractor shall be required to submit, for approval, a detailed working method statement for the protection of trees prior to undertaking any works adjacent to all retained trees, including trees in contractor's works areas	Tree Protection Specifications have been provided in the relevant Contract Specifications respectively for implementation by the Contractors under the Project. The Contractors' performance on the implementation of the trees maintenance and protection measures was observed and checked by the ET weekly during construction period.	3508, 132kV Cable
CM9 – Trees unavoidably affected by the works shall be transplanted where practical. A detailed Tree Transplanting Specification shall be provided in the Contract Specification, if applicable. Sufficient time for necessary tree root and crown preparation periods shall be allowed in the project programme	Tree Transplanting Specifications have been provided in the relevant Contract Specifications respectively for implementation by the Contractors under the Project where trees will unavoidably be affected by the construction works. The Contractors were required to submit Method Statements for tree transplanting prior to the transplanting works. Tree inspections were conducted by ET to check the tree transplanting works implemented by the Contractors on site. The Contractors' performance on the implementation of trees maintenance and protection measures on transplanted trees was observed and checked by the ET bi-monthly during the 12-month establishment period after the completion of each batch of transplanting works. Long term management of the transplanted trees were currently monitored by ET annually.	3508
CM 10 – Land formation works shall be followed with advanced hydroseeding around taxiways and runways as soon as practical	The Contractor's performance on the implementation of advanced hydroseeding works was observed and checked by the ET during the weekly site inspection.	-
OM7- Compensatory tree planting for all felled trees shall be provided to the satisfaction of relevant Government departments. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under the relevant technical circulars. ⁽¹⁾	The two batches of compensatory trees were planted and the bi-monthly site inspection for the 12-month establishment period was commenced. During the reporting period, the bi-monthly site inspection was undertaken in June, August, October and December 2023.	AAHK

Note:

AAHK is the management and maintenance agency of the compensatory trees. Tree Felling Application is not required for 3RS Project.

The 3RS Project is a mega project comprising a number of detailed design contracts and numerous construction works contracts at different stages of design and construction. The works areas would be taken up by different 3RS works contracts in stages as construction advanced.

The landscape and visual elements associated with these contracts of the 3RS Project would also be designed and implemented in phases throughout the duration of the Project.

Since the EIA stage, the proposed tree treatments were adjusted to reflect updated baseline conditions, such as damage from typhoons, and the availability of more detailed design information for project buildings and infrastructure. These treatment figures were subsequently revised and incorporated into the latest Landscape and Visual Plan.

Environmental monitoring and audit work which included the auditing of contractor's work in landscape and visual aspects such as tree preservation, protection and transplantation was implemented in accordance with the updated construction programme, the relevant requirements of the EP, the Updated EM&A Manual and the approved Landscape & Visual Plan.

The total number of retained trees, transplanted trees and to-be-transplanted trees under the management of Project are summarized in **Table 2.15**. The tree schedule updated as of the end 2025 is shown in **Appendix G**.

Table 2.15: Summary of the Number of Retained, Transplanted and To-be-transplanted Trees as of December 2025

Contract No.	Retained (nos.)	Transplanted (nos.)		To-be-transplanted (nos.)
		Establishment Period	Maintenance Period	
3503 ⁽¹⁾	0	0	9	0
3508	21	0	12	0
3801 ⁽²⁾	0	0	5	0
132kV Cable	45	0	0	0
Grand Total	66	0	26	0

Note:

- Contract 3503 was completed and the 9 transplanted trees, including T835, T836, T838, T812, T814, T815, T829, T830 and T831, were handed over to AAHK in February 2022.
- Contract 3801 was completed and the 5 transplanted trees, including CT276, CT1253, CT1194, CT1794 and CT1795, were handed over to other management agencies. Details of the management agency are presented in **Table 2.17**.

Table 2.16 lists the affected tree ID together with the reasons for change of tree status between the tree schedules as of the end 2024 and the end 2025.

The total number of retained trees of the Project as of the end of 2025 was 66. Compared to 24 nos. of retained trees reported in the tree schedule as of the end of 2024, the change in number was due to the following reasons:

- The works of 132kV Cable commenced the maintenance of retained trees. (+52 nos.)
- Three retained trees under Contract 3508 were handed over to AAHK. (-3 nos.)
- Under the works of 132kV Cable, a total of seven trees were removed, comprising three trees due to Typhoon Whipa (-3 nos.), two trees due to Typhoon Ragasa (-2 nos.), and two trees due to tree mortality (-2 nos.).

Table 2.16: Summary of the Tree Status Changes between end 2024 and end 2025

Tree ID(s)	Contract	Status of 2024	Status as of end 2025	Remarks	Impacts to Total Tree Number
Section 5: T001, T002, T004, T007, T013, T014, T016, T017, T019, T020, T021, T023, T024, T025, T031, T045, T046, T057, T048, T054, T055, T056, T061, T064, T065, T066, T068, T069, T072, T075, T083, T084, T087, T089, T091, T094, T095, T098, T103, T104, T107, T112, T113, T126, T133, T134, T135, T140, T142, T146 & T148 Section 6: T136	132kV Cable	Retain	Retain	52 nos. of trees were maintained under the works of 132kV Cable starting from March 2025.	Retain: +52 nos.
T813, T833 & T834	3508	Retain	Retain	3 nos. of tree were handed over to AAHK in September 2025.	Retain: -3 nos.
Section 5: T023, T024 & T025	132kV Cable	Retain	Fell	3 nos. of tree were collapsed and removed in September 2025 due to Typhoon Whipa.	Retain: -3 nos.
Section 5: T064 & T095	132kV Cable	Retain	Fell	2 nos. of tree were removed in October 2025 due to Typhoon Ragasa.	Retain: -2 nos.
Section 5: T054 & T133	132kV Cable	Retain	Fell	2 nos. of tree were dead and removed in December 2025.	Retain: -2 nos.

In this reporting period, the cumulative total number of transplanted trees under the Project remained unchanged (i.e., 26) comparing to the previous reporting period. The details of transplanted trees are summarised in **Table 2.17**. Photos of the transplanted trees are presented in **Table 2.18**.

During the reporting period, the bi-monthly site inspections of compensatory trees under the 12-month establishment period were undertaken in January, March, April, May, July, August, September, October, November and December 2025. In addition, annual site inspections for the long term management period were undertaken in April and May 2025.


Table 2.17: Details of the Transplanted Trees

Tree ID	Transplant Date	Management Stage	Management Agency	Remarks
CT276	3 May 2018	Long Term Management period Jun 2019 – May 2028	Southern Landside Petrol Filling Station	Establishment Period was completed. Next inspection will be conducted in February 2026.
CT1253	4 May 2018	Long Term Management period Jun 2019 – May 2028	Southern Landside Petrol Filling Station	
T835	22 Jan 2020	Long Term Management period Feb 2021 – Jan 2030	AAHK	Establishment Period was completed. The trees within the land parcel were acquired for construction of infrastructure. The trees were felled in 2023.
T836	13 Dec 2019	Long Term Management period Feb 2021 – Jan 2030	AAHK	
T838	22 Jan 2020	Long Term Management period Feb 2021 – Jan 2030	AAHK	
T812	21 Dec 2020	Long Term Management period Jan 2022 – Dec 2031	AAHK	Establishment Period was completed. Next inspection will be conducted in December 2026.
T814	20 Dec 2020	Long Term Management period Jan 2022 – Dec 2031	AAHK	
T815	15 Dec 2020	Long Term Management period Jan 2022 – Dec 2031	AAHK	
T829	18 Dec 2020	Long Term Management period Jan 2022 – Dec 2031	AAHK	
T830	14 Dec 2020	Long Term Management period Jan 2022 – Dec 2031	AAHK	
T831	19 Dec 2020	Long Term Management period Jan 2022 – Dec 2031	AAHK	
T1493	6 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	Establishment Period was completed. Next inspection will be conducted in July 2026.
T1494	6 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1495	10 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1496	5 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1497	5 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1498	29 Jun 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1499	29 Jun 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	

Tree ID	Transplant Date	Management Stage	Management Agency	Remarks
T1500	30 Jun 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1501	30 Jun 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1502	5 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1503	6 Jul 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
T1504	24 Jun 2021	Long Term Management period Aug 2022 – Jul 2031	Contract 3508	
CT1194	4 May 2018	Long Term Management period Jun 2019 – May 2028	Southern Landside Petrol Filling Station	Establishment Period was completed. Uprooted and collapsed due to Typhoon Higos on 18 August 2020. Tree removal was conducted as recommended by tree specialist of the contractor of Southern Landside Petrol Filling Station.
CT1794	3 May 2018	Long Term Management period Jun 2019 – May 2028	AsiaWorld-Expo	Establishment Period was completed. The tree within the land parcel was acquired by the government for construction of emergency hospital to handle COVID19 pandemic at AsiaWorld-Expo. The tree was felled in late 2020.
CT1795	3 May 2018	Long Term Management period Jun 2019 – May 2028	AsiaWorld-Expo	Establishment Period was completed. The tree within the land parcel was acquired by the government for construction of emergency hospital to handle COVID19 pandemic at AsiaWorld-Expo. The tree was felled in late 2020.

Table 2.18: Photos of the Existing Transplanted Trees in the Reporting Period

Under 10-year Long-term Management (Jun 2019 – May 2028):		
		
CT276	CT1253	
Under 10-year Long-term Management (Jan 2022 – Dec 2031):		
		
T812	T814	T815
		
T829	T830	T831

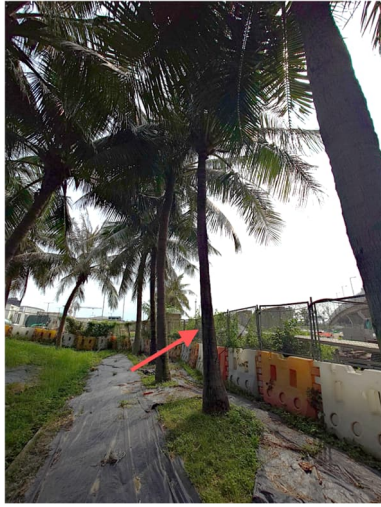Under 10-year Long-term Management (Aug 2022 – Jul 2031):		
		
T1493	T1494	T1495
		
T1496	T1497	T1498
		
T1499	T1500	T1501



2.8 Environmental Site Inspection

Site inspections of the construction works were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. Bi-weekly site inspections were also conducted by the IEC. Besides, ad-hoc site inspections were conducted by ET and IEC if environmental problems were identified, or subsequent to receipt of an environmental complaint, or as part of the investigation work. During the reporting period, ET conducted 822 sessions of site inspections and 155 sessions of ad-hoc site inspections. These site inspections provided a direct means to reinforce the specified environmental protection requirements and pollution control measures in construction sites.

During site inspections, environmental situation, status of implementation of pollution control and mitigation measures were observed both within the site area as well as outside the project sites which was likely to be affected, directly or indirectly, by the site activities. Environmental documents and site records, including waste disposal records, maintenance records of environmental equipment, and relevant environmental permits and licences, were also checked on site. Observations were recorded in the site inspection checklist and passed to the contractor together with the appropriate recommended mitigation measures where necessary in order to advise contractors on environmental improvement, awareness and on-site enhancement measures. The observations were made with reference to the following information during the site inspections:

- The EIA and EM&A requirements;
- Relevant environmental protection laws, guidelines, and practice notes;
- The EP conditions and other submissions under the EP;
- Monitoring results of EM&A programme;
- Works progress and programme;
- Proposal of individual works;
- Contract specifications on environmental protection; and
- Previous site inspection results.

Good site practices were observed in site inspections during the reporting period. Advice was given when necessary to ensure the construction workforces were familiar with relevant procedures, and to maintain good environmental performance on site. Regular toolbox talks on

environmental issues were organized for the construction workforces by the contractors to ensure understanding and proper implementation of environmental protection and pollution control mitigation measures.

Summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix C**.

2.9 Audit of the SkyPier High Speed Ferries

The Marine Travel Routes and Management Plan for High Speed Ferries of SkyPier (the SkyPier Plan) was submitted to the Advisory Council on the Environment (ACE) for comment and subsequently submitted to and approved by EPD in November 2015 under EP Condition 2.10. The approved SkyPier Plan is available on the dedicated website of the Project. In the SkyPier Plan, AAHK has committed to implementing the mitigation measure of requiring HSFs of SkyPier travelling between HKIA and Zhuhai / Macau to start diverting the route with associated speed control across the area, i.e. SCZ, with high CWD abundance. The route diversion and speed restriction at the SCZ have been implemented since 28 December 2015. The IEC has also performed audit on the compliance of the requirements as part of the EM&A programme.

According to the approved SkyPier Plan, dolphin habitat index was reviewed in the reporting period based on findings of the AFCD's marine mammals monitoring report 2024-25 and historical dolphin density records. Grids for dolphin hotspots remained largely unchanged, thus the HSF route diversion arrangement remained unchanged.

Due to the operational needs, the SkyPier HSF services to/from Zhuhai has been suspended since 25 March 2020. In total, 6 ferry movements between HKIA SkyPier and Macau were audited in the reporting period. All 6 audited ferry movements travelled through the SCZ with average speeds of 15 knots or below, complying with the SkyPier Plan. The latest summary of key audit findings in the reporting period is presented in **Table 2.19**.

Table 2.19: Summary of Key Audit Findings against the SkyPier Plan

Key Findings	Audit	Jan -25	Feb -25	Mar -25	Apr -25	May -25	Jun -25	Jul -25	Aug -25	Sep -25	Oct -25	Nov -25	Dec -25
Total number of HSF movements recorded and audited for HSFs to/from Macau		6	0	0	0	0	0	0	0	0	0	0	0
Use diverted route and enter / leave SCZ through Gate Access Points		6	0	0	0	0	0	0	0	0	0	0	0
No. of SkyPier HSFs in compliance with average speed within 15 knots in SCZ		6	0	0	0	0	0	0	0	0	0	0	0

Source: Excerpted from Monthly EM&A Report No. 109 – 120.
Remarks: No HSF services to/from Macau from Feb to Dec 2025.

2.10 Audit of the Construction and Associated Vessels

The audit of construction and associated vessels in accordance with the Marine Travel Route and Management Plan for Construction and Associated Vessel (MTRMP-CAV) has been conducted

since August 2016. The ET has audited relevant information including Automatic Identification System (AIS) data, vessel tracks and other relevant records provided by the contractors to ensure that the contractors were fully complied with the requirements of the MTRMP-CAV. The Maritime Surveillance System (MSS) was launched in March 2017 and has automatically recorded deviation cases such as speeding, entering no entry zone, and not travelling through designated gates. The ET conducted checking to ensure the MSS recorded all deviation cases accurately.

The updated MTRMP-CAV was approved by EPD on 16 May 2025 under EP Condition 2.9. Following its implementation, the MSS continued to automatically record any deviations, while the ET conducted bi-weekly audits of relevant records up to May 2025. From June 2025 onwards, the ET audited construction and associated vessels activities based on the marine travel routes records submitted by the contractors and the ET also conducted separate monthly checks of construction and associated vessels travel routes. Deviation cases such as speeding, vessel not turning on AIS and berthing within the NLMP were identified, and all the relevant contractors were reminded to adhere to the requirements outlined in the MTRMP-CAV. The contractors continued to submit 3-month rolling vessel plans for construction vessel activities to AAHK in order to help maintain the number of construction vessels at a practicable minimum. The IEC also carried out compliance audits as part of the EM&A programme.

A total of one skipper training workshop was held by ET during the reporting period with one skipper / captain of construction vessels associated with the 3RS contracts to familiarise him with the predefined routes, provide general education on local cetaceans, outline guidelines for minimising adverse water quality impact, detail the required environmental practices / measures and safety measures for operating construction and associated vessels in the presence of CWDs. In addition, five skipper training workshops were held by contractors' Environmental Officers with seven skippers / captains and competency tests were conducted subsequently with the trained skippers / captains by ET to assess the trainees' understanding and readiness. Furthermore, the ET participated in Marine Management Liaison Group meetings to assist in resolving any marine-related issues encountered during the Project.

2.11 External Stakeholder Engagement

In accordance with the EP's requirements of setting up Community and Professional Liaison Groups, the AAHK has been continuing to proactively reach out to a wide spectrum of external stakeholders to update them on the environmental aspects of the Project and to seek their insights and views. There were continuous exchanges with the local communities, relevant professionals, experts, and other stakeholders. Below are highlights of the engagement activities held in 2025.

2.11.1 Community Liaison Groups

In order to enhance transparency and communication with the community in a proactive way, five Community Liaison Groups (CLGs) were set up in 2012 in the neighbouring districts of HKIA, namely Islands, Kwai Tsing, Shatin, Tsuen Wan and Tuen Mun. The CLGs are comprehensive platforms for the AAHK to update the community leaders about the detailed design, progress of construction and operation, and environmental monitoring and audit results of the Project, and listen to their views on various topics related to HKIA and the Project, including environmental matters. The AAHK also leverages on the CLGs to exchange views with the community on the latest airport developments, hence enhancing airport services and helping to contribute to the betterment of these districts. The CLGs have a total of about 150 members involving district councillors and community leaders. In 2025, two meeting cum airport visit were held in June and December. Project information including the latest development of the 3RS project, environmental monitoring and audit results, and details on the implementation of environmental and ecological enhancement measures were presented in the meetings.

2.11.2 Professional Liaison Group and Green Non-Governmental Organizations

The Professional Liaison Group, comprising 19 members of relevant professionals and experts, was set up to enhance transparency and communication, as well as enquiries and complaints-handling on all environmental issues related to the Project; and to promote community cooperation and participation and implementation of suitable local environmental enhancement works that are included in the Environmental Permit. In 2025, a meeting cum eco-tour in the West Lantau waters was held in May.. Project information including the latest development of the 3RS Project, environmental monitoring and audit results, and details on the implementation of environmental and ecological enhancement measures were presented in the meeting.

Roundtable meetings with Green Non-Governmental Organizations (NGOs) were proactively arranged to facilitate exchanges on environmental issues related to the Project. Updates of the Project, and details on the implementation of environmental and ecological enhancement measures were shared with the participants. In 2025, a meeting cum eco-tour in the West Lantau waters was held in May.

2.11.3 Fishermen Liaison

In an effort to deepen outreach to the fishermen community, a dedicated Fishermen Liaison Group was set up in November 2016 to share updates on environmental matters and progress of construction and operation with the chairmen and leaders of fishermen groups and associations. In 2025, a meeting was held in June.

2.11.4 Other Stakeholders

The AAHK submitted an information paper to the Legislative Council Panel on Economic Development in March 2025, providing an update on the commissioning of the 3RS project and post-commissioning airport operations. Furthermore, the AAHK submitted a paper to the Advisory Council on the Environment (ACE) in July 2025 reporting an update on the implementation of the environmental mitigation and enhancement measures in association with the 3RS Project.

To encourage two-way communications with stakeholders and the community, a dedicated telephone hotline and email has been set up since December 2015. Six enquiries were received via the telephone hotline and twenty-six enquiries were received via the dedicated email in 2025.

2.12 Review of the Key Assumptions Adopted in the EIA Report

With reference to Appendix E of the Manual, it is noted that the key assumptions adopted in approved EIA Report for the construction phase are still valid and no major changes are involved. The environmental mitigation measures recommended in the approved EIA Report remain applicable and shall be implemented in undertaking construction works for the Project.

2.13 Key Environmental Issues for the Coming Reporting Period

The key environmental issues for the Project in the coming reporting period are expected to be associated with construction activities including:

- Generation of dust from construction works and stockpiles;
- Noise from operating equipment and machinery on-site;
- Generation of site surface runoffs and wastewater from activities on-site;
- Sorting, recycling, storage and disposal of general refuse and construction waste;
- Reuse of treated marine sediments from piling and excavation works; and
- Management of chemicals and avoidance of oil spillage on-site.

The implementation of required mitigation measures by the contractors will be monitored by the ET.

3 Report on Non-compliance, Complaints, Notifications of Summons and Prosecutions

3.1 Compliance with Other Statutory Environmental Requirements

During the reporting period, environmental related licenses and permits required for the construction activities were checked. No non-compliance with environmental statutory requirements was recorded.

3.2 Analysis and Interpretation of Complaints, Notification of Summons and Status of Prosecutions

3.2.1 Complaints

Three environmental complaints were received during the reporting period, all of which were related to air quality. The ET conducted investigations for each complaint in accordance with the Manual and the Complaint Management Plan. A summary of the complaints and corresponding analysis is presented in **Appendix F**.

3.2.2 Notifications of Summons or Status of Prosecution

No notification of summonses or prosecutions were received in the reporting period.

3.3 Cumulative Statistics

Cumulative statistics on exceedance, non-compliance, complaints, notifications of summons and status of prosecutions are summarized in **Appendix F**.

4 Conclusion and Recommendation

The new North Runway was commissioned in November 2022. Following the completion of reconfiguration works on the Centre Runway, the 3RS was commissioned on 28 November 2024. Meanwhile, the expanded Terminal 2 (T2) is being launched in phases, with the first phase of operation commenced on 23 September 2025.

During the reporting period from 1 January 2025 to 31 December 2025, the EM&A programme has been implemented in accordance with the Manual of the Project. The EM&A works carried out during the reporting period included construction dust and noise measurements, waste monitoring, and landscape and visual monitoring and environmental site inspections for the Project's construction works.

The monitoring results in relation to the construction dust, construction noise and construction waste did not trigger their corresponding Action or Limit Levels during the reporting period.

The excavation and treatment of marine sediment were completed in February 2025. The remaining treated marine sediment is stockpiled properly at 3RS Project site area, awaiting backfilling.

A total of around 5352.7 km survey effort was conducted for the vessel line-transect monitoring for CWDs during the 12-month operation phase monitoring period. A total of 166 groups of 466 CWDs were sighted in NWL, AW, WL and SWL survey areas. No CWDs were recorded in the NEL survey area. Overall abundance of CWD in Hong Kong western waters was estimated at 30 dolphins in 2025 from line-transect analysis. According to the Updated EM&A Manual, all CWD monitoring under the EM&A requirement was completed.

On the implementation of DEZ Plan, dolphin observers were deployed by the contractors for continuous monitoring of the DEZ for armour rock laying works in accordance with the DEZ Plan. Trainings for the dolphin observers on the implementation of MMWP and DEZ monitoring were provided by the ET prior to the aforementioned works. As for DEZ monitoring records, no dolphins or other marine mammals were observed within the DEZs in this reporting period.

Site inspections and audits were undertaken in accordance with the monitoring programme for landscape and visual impacts during construction and establishment works phases. No non-conformities were recorded during the reporting period.

A total of 6 ferry movements between HKIA SkyPier and Macau were audited in the reporting period. All audited movements travelled through the SCZ with average speeds of 15 knots or below, complying with the SkyPier Plan.


The audit of construction and associated vessels has been conducted since August 2016. The updated MTRMP-CAV was approved by EPD on 16 May 2025 under EP Condition 2.9. Following its implementation, the MSS continued to automatically record any deviations, while the ET conducted bi-weekly audits of relevant records up to May 2025. From June 2025 onwards, the ET audited construction and associated vessels activities based on the marine travel routes records submitted by the contractors and the ET also conducted separately monthly checks of the construction and associated vessels travel routes. Deviation cases such as speeding, vessel not turning on AIS and berthing within the NLMP were identified, and all the relevant contractors were reminded to adhere to the requirements outlined in the MTRMP-CAV. A total of one skipper training workshop was conducted by the ET during the reporting period with captains of construction vessels associated with 3RS contracts. Another five skipper training workshops were

held by contractors' Environmental Officers and competency tests were conducted subsequently with the trained captains by ET.

AAHK strives to be highly transparent in its works and continues to engage with stakeholders through meetings and communications. Having said that, the dedicated 3RS Project website provides up-to-date information including EM&A results, updated plans and submissions in accordance with requirements in the EP, materials of the liaison group meetings, flyers introducing environmental initiatives of the 3RS Project, as well as information on the status and operation of the Marine Ecology Enhancement Fund and the Fisheries Enhancement Fund.

Overall, the recommended environmental mitigation measures, as included in the EM&A programme, have been effectively implemented during the reporting period. Also, the EM&A programme implemented by the ET has effectively monitored the construction activities and ensured the proper implementation of mitigation measures.

Figures

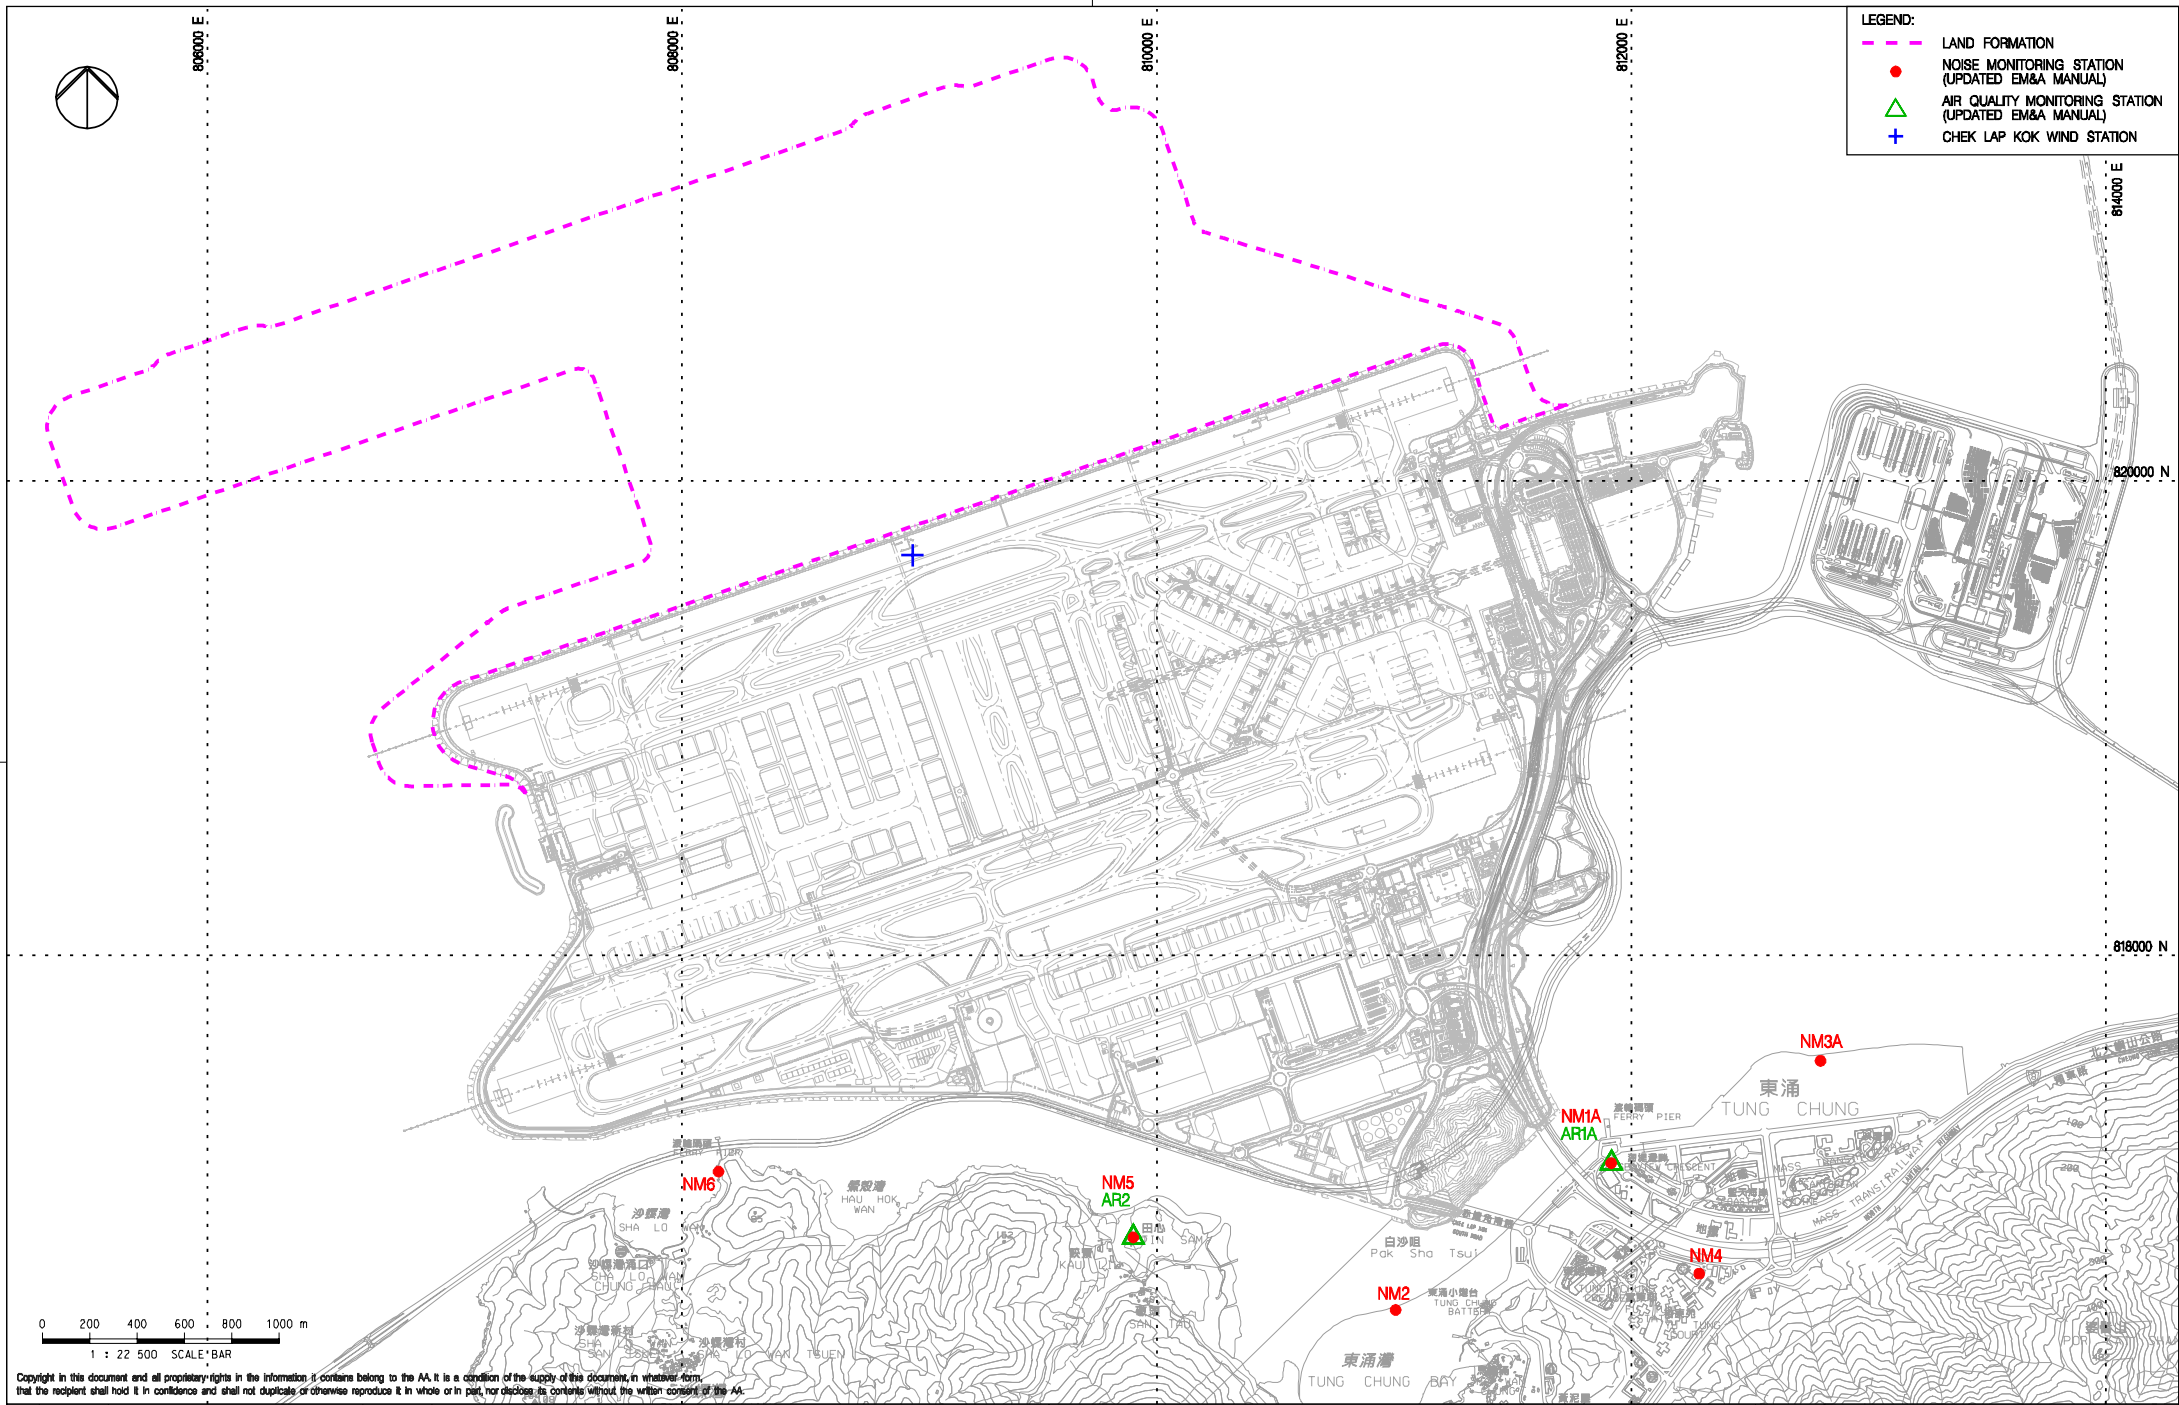

Copyright in this document and all proprietary rights in the information it contains belong to the AA. It is a condition of the supply of this document, in whatever form, that the recipient shall hold it in confidence and shall not duplicate or otherwise reproduce it in whole or in part, nor disclose its contents without the written consent of the AA.

Rev.	Date	Description	Checked
A	06JAN16	FIRST ISSUE	RO
B	29JAN16	GENERAL REVISION	RO
C	11FEB16	GENERAL REVISION	RO
D	29OCT18	GENERAL REVISION	SH



Title
LOCATIONS OF AIR AND NOISE MONITORING STATIONS AND CHEK LAP KOK WIND STATION


Consultant's Signatures for Approval		Date
Design	TK	29OCT18
Checkers	TK	29OCT18
Approver	EC	29OCT18


EXPANSION OF HONG KONG INTERNATIONAL AIRPORT INTO A THREE-RUNWAY SYSTEM		Scale at A3
Drawing No.	FIGURE 2.1	1 : 22500
Rev.		D

D-2. NC.

[illegible]

Figure 2.3 - The Backfilling Locations of Treated Marine Sediment (Not to Scale)

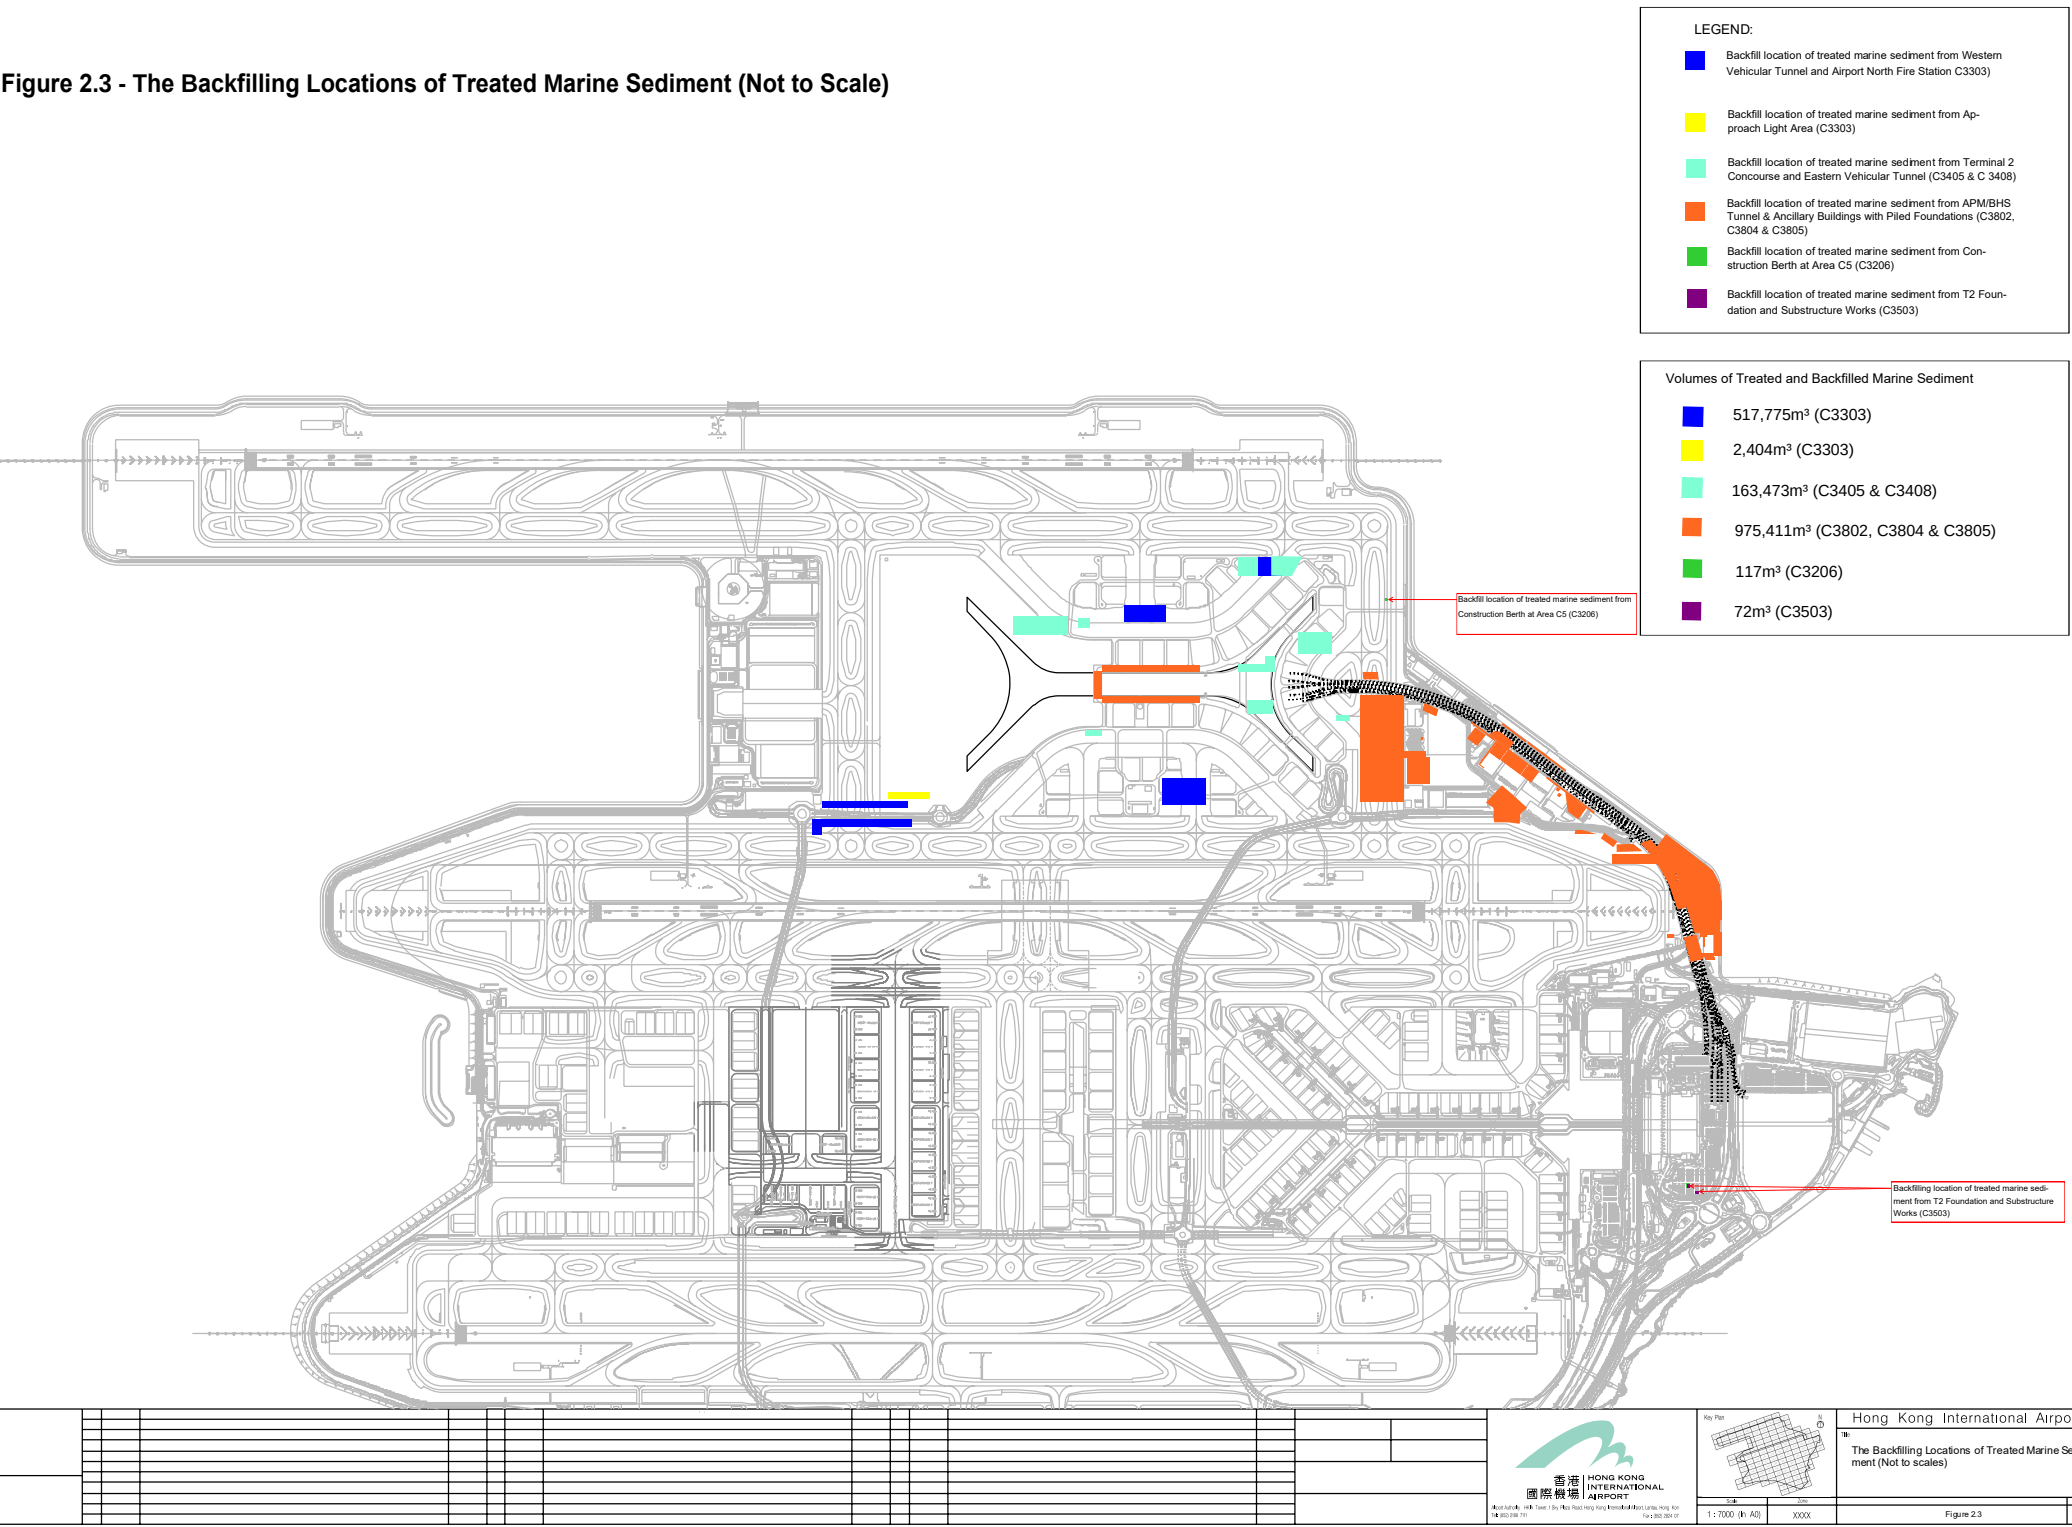

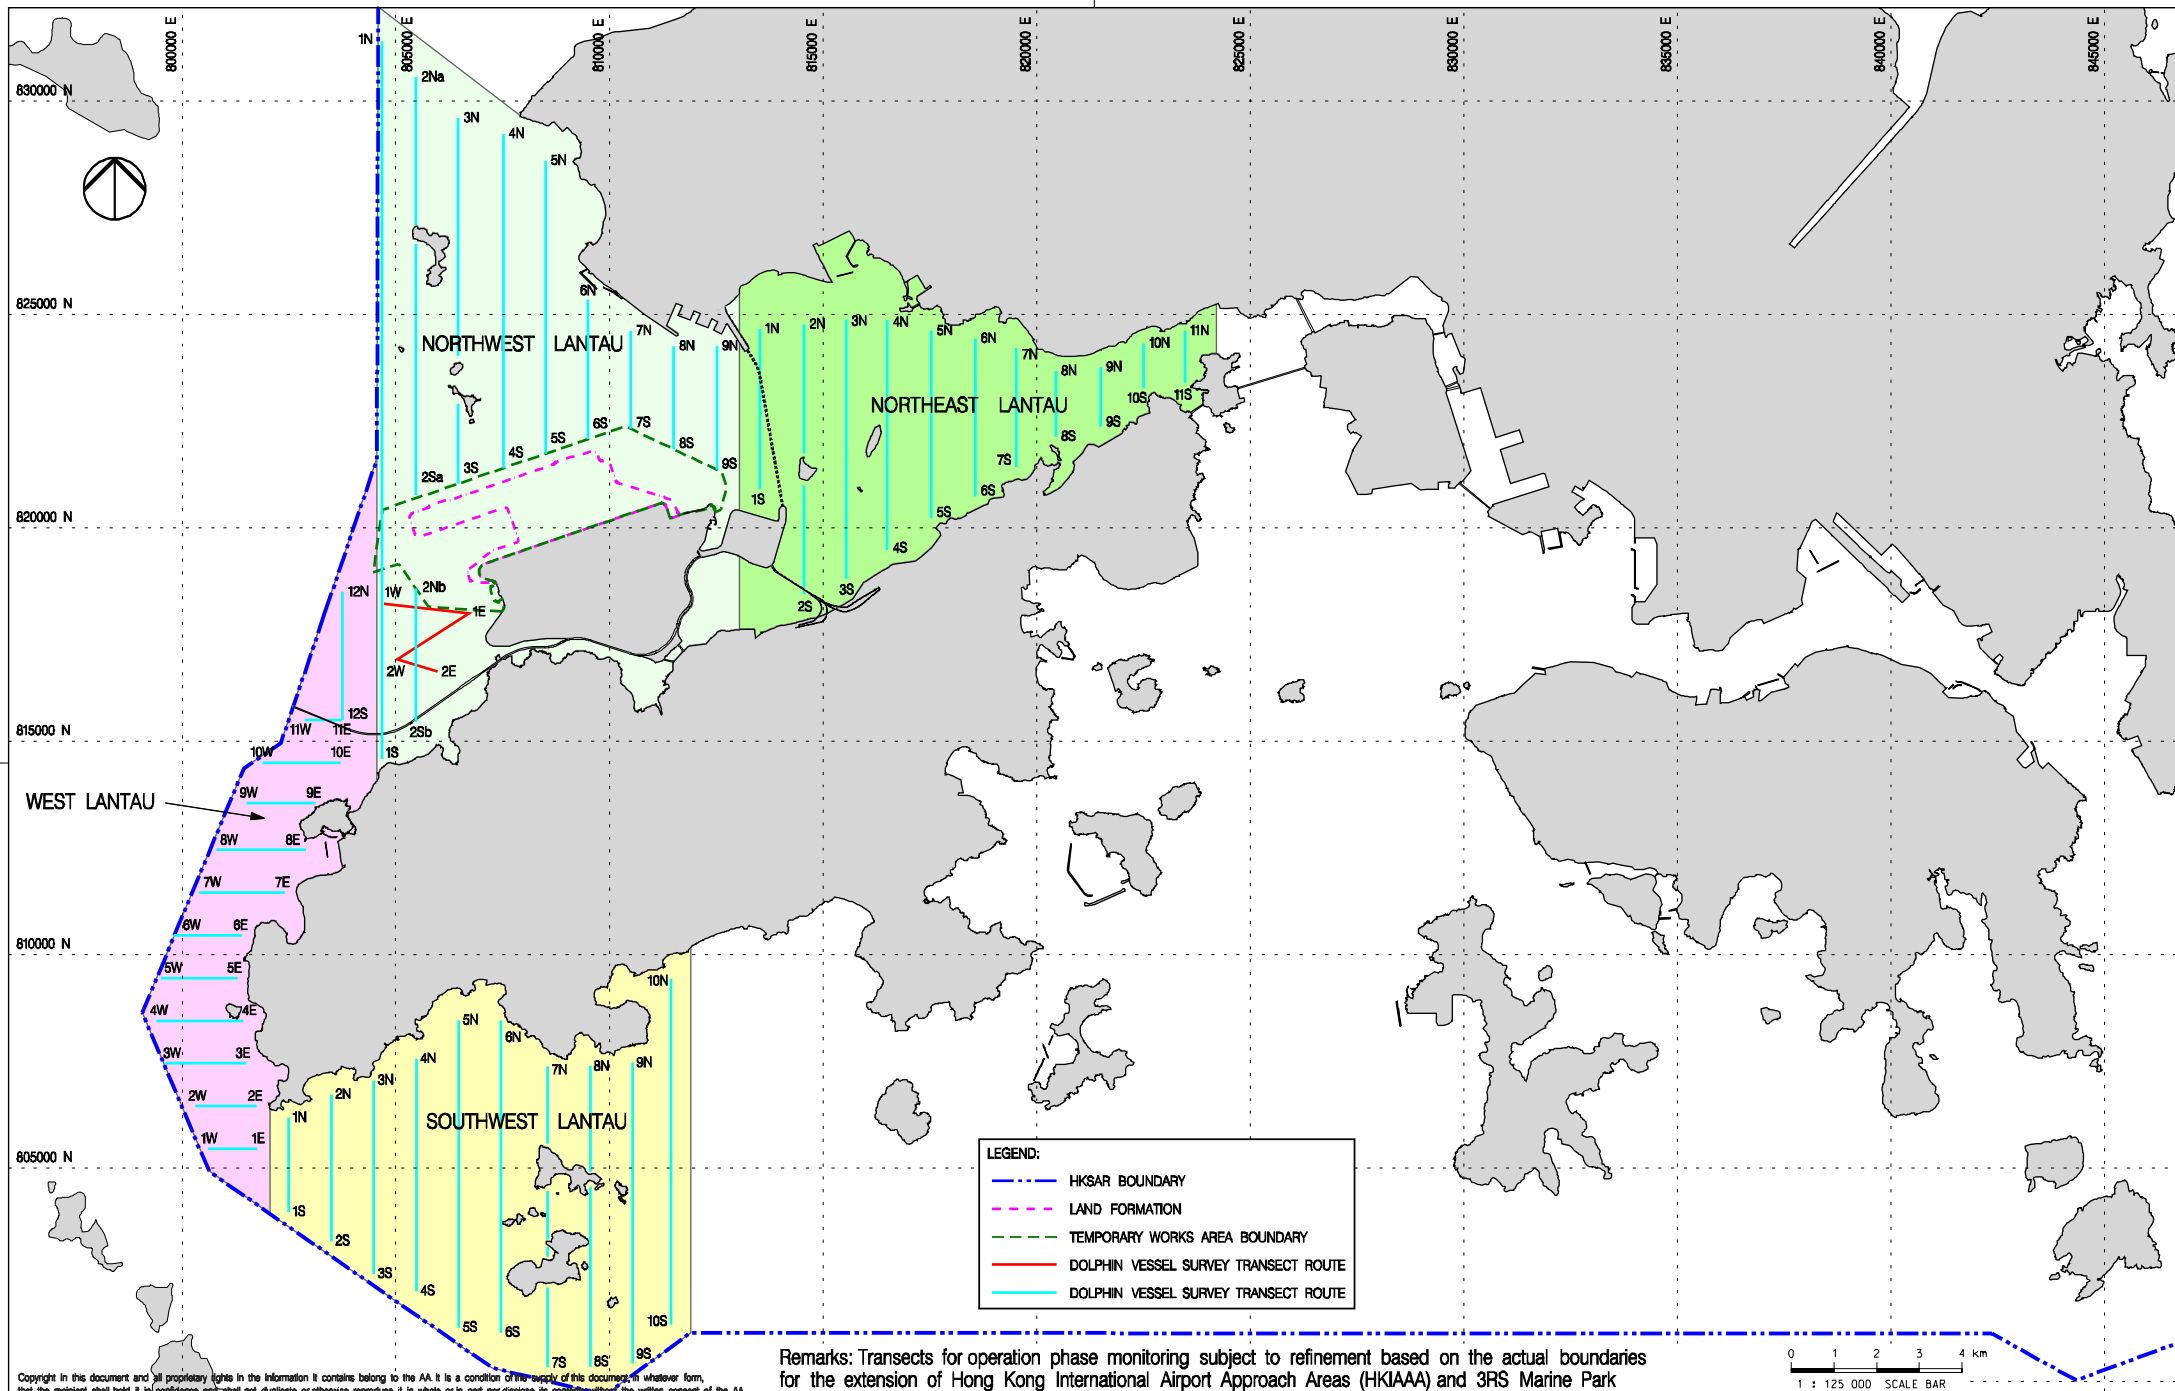

Copyright in this document and all proprietary rights in the information it contains belong to the AA. It is a condition of the supply of this document, in whatever form, that the recipient shall hold it in confidence and shall not duplicate or otherwise reproduce it in whole or in part, nor disclose its contents without the written consent of the AA.

Remarks: Transects for operation phase monitoring subject to refinement based on the actual boundaries for the extension of Hong Kong International Airport Approach Areas (HKIAAA) and 3RS Marine Park

Rev.	Date	Description	Checked
B	27JUL16	GENERAL REVISION	JT
C	08FEB17	GENERAL REVISION	JT
D	01MAR17	GENERAL REVISION	JT
E	29OCT18	GENERAL REVISION	SH
F	04APR19	GENERAL REVISION	SH



Title
VESSEL BASED DOLPHIN MONITORING
TRANSECTS IN CONSTRUCTION,
POST-CONSTRUCTION AND OPERATION PHASES

Consultant's Signatures for Approval		Date
Design	JC	04APR19
Checkers	JC / TK	04APR19
Approver	EC	04APR19

EXPANSION OF HONG KONG INTERNATIONAL AIRPORT INTO A THREE-RUNWAY SYSTEM	
Drawing No.	Scale at A3 1:125000
FIGURE 2.4	Rev. F

Appendix A. Contract Description

Contract Description

Contract No.	Contract Title	Contractor	Key Construction Activities
3206	Main Reclamation Works	Zhen Hua Engineering Company Ltd.-China Communications Construction Company Ltd.-CCCC Dredging (Group) Company Ltd. Joint Venture	The works covered by the Contract 3206 comprise the formation of approximately 650 hectares of land north of the existing airport island for the project, the major construction activities including without limitation the following • Geotechnical and ground improvement works; • Seawall construction; • Marine and land filling works; and • Civil works.
3305	Airfield Ground Lighting System	ADB Safegate Hong Kong Limited	The works covered by the Contract 3305 comprise the design, manufacture, installation and handover of the Airfield Ground Lighting (AGL) System. The major construction activities include without limitation the following: • Light fittings works; • Power Supply System installation; • Fibre optic cables and data cables supply and connection; • Set up Control and Communication system; and • All associated testing and commissioning works.
3310	North Runway Modification Works	China State Construction Engineering (Hong Kong) Ltd.	The works cover by the Contract 3310 comprise the modification of north runway and the connections of taxiways to the modified north runway on existing airport island. The major construction activities include without limitation the following: • Modification works for existing north runway; • Connections works for new taxiways; • Construction of ancillary buildings/ facilities; • Building services and airport systems; • Infrastructure Works; • Underground utilities and services; and • All associated asphalt pavement work and earthwork.
3404	Integrated Airport Control System	Shun Hing Systems Integration Co., Ltd.	The works covered by the Contract 3404 comprise the design, supply, manufacture, delivery, installation, testing and commissioning of Integrated Airport Control System and conversion of the existing Integrated Airport Centre (IAC) into a Back-up IAC for the operation of interim Two-Runway System and

Contract No.	Contract Title	Contractor	Key Construction Activities
			Three-Runway System. The major construction activities include without limitation the following: • Cabling works • System configuration and programming works; • Set up Control and Communication system; • Decommissioning works; and • All associated testing and commissioning works.
3405	Third Runway Concourse Foundation and Substructure Works	China Road and Bridge Corporation - Bachy Soletanche Group Limited - LT Sambo Co., Ltd. Joint Venture	The works covered by the Contract 3405 comprise without limitation the following: • Piled foundation works; • Basement and tunnel structure works; • Associated internal reinforced concrete structures; • Backfilling and compaction of works area; and • Associated testing and temporary works.
3408	Third Runway Concourse and Apron Works	Beijing Urban Construction Group Company Limited and Chevalier (Construction) Company Limited Joint Venture	The works covered by the Contract 3408 comprise the design and construction of the Third Runway Concourse (TRC), the TRC Apron, two cross-field taxiways, Ancillary Buildings, specific section of the Eastern Vehicular Tunnel (EVT), and the associated infrastructure, testing, and commissioning works.


Contract No.	Contract Title	Contractor	Key Construction Activities
3508	Terminal 2 Expansion Works	Gammon Engineering and Construction Co., Ltd	The works covered by the Contract 3508 comprise the construction of T2, North Annex Building (NAB) and South Annex Building (SAB) with interconnecting bridges, landside transport infrastructure including viaducts and at grade roads, underground utility services, one sewage pumping station with the associated electrical building, footbridges, external works and modification works to existing facilities. The major construction activities include without limitation the following: • Superstructure, interior landscaping, building services and airport system of T2, NAB, SAB and associated footbridges; • Additions and Alteration (A&A) works of the existing Airport World Trade Centre (AWTC); • Modification of the existing APM and BHS tunnels; • External works and road networks around T2; and • Utilities.
3601	New Automated People Mover System (TRC Line)	CRRC Puzhen Bombardier Transportation Systems Limited and CRRC Nanjing Puzhen Co., Ltd. Joint Venture	The works covered by the Contract 3601 comprise the initial phase of the Automated People Mover (APM) system connecting the Third Runway Concourse (TRC) and the APM Interchange Station in the modified T2, and extension of the new APM system into the new APM Depot east of T2. The major construction activities include without limitation the following: • New 3-guideway APM system between TRC and T2; • Extension of the TRC Line into the new APM Depot; • APM associated sub-systems (communications, signalling, etc.) • Associated civil works; and • All associated testing, commissioning works.
3602	Existing APM System Modification Works	Niigata Transys Co., Ltd.	The works covered by the Contract 3602 comprise the detailed design, supply, manufacture, fabrication, implementation, testing and commissioning of the following modification works of the existing APM systems. The major construction activities include without limitation the following: • Modification of existing APM depot and APM cars; • Modification of existing T1 & T2 tunnels; and • Preparation of new APM depot.

Contract No.	Contract Title	Contractor	Key Construction Activities
3603	3RS Baggage Handling System (BHS)	Vanderlande Industries Hong Kong Limited and Shun Hing Systems Integration Company Limited	The works covered by the Contract 3603 comprise the design, supply, manufacture, delivery, installation, testing and commissioning of the high-speed baggage handling system.
3721	Construction Support Infrastructure Works	China State Construction Engineering (Hong Kong) Limited	The works covered by the Contract 3721 comprise the construction of the infrastructure works and building facilities on the reclaimed land formation. The major construction activities include without limitation the following: • Project site road; • Utilities; • Cargo loading quays; and • Security fencing and hoarding.
3728	Minor Site Works	Shun Yuen Construction Company Limited	The works to be executed by the Contract 3728 comprise minor works within the Airside and Landside areas of the existing airport island to support the Project.
3733	Emergency Repair Service	Wing Hing Construction Co., Ltd.	The works to be executed by the Contract 3733 comprise the provision of emergency repair service for Three Runway System (3RS) Project construction. The major construction activities include without limitation the following: • Construction of support facilities; • Building services works; • Security fencing and hoarding; and • Ground pavement works.
3801	APM and BHS Tunnels on Existing Airport Island	China State Construction Engineering (Hong Kong) Limited	The works covered by the Contract 3801 comprise the construction of the APM and Baggage Handling System (BHS) tunnels on existing airport island. The major construction activities include without limitation the following: • Construction of APM and BHS tunnels; • Construction of ventilation building and associated infrastructure; and • Construction, testing and commissioning of sewerage pumping station; and • Civil and structural engineering works.
3802	APM and BHS Tunnels and Related Works	Gammon Construction Limited	The works covered by the Contract 3802 comprise the construction of the APM and BHS tunnels on existing airport island. The major construction activities include without limitation the following:

Contract No.	Contract Title	Contractor	Key Construction Activities
			• Construction of APM/ BHS Tunnels; • Construction of ancillary buildings/ facilities; • Building services and airport systems; • Infrastructure Works; • Underground utilities and services; and • All associated testing and commissioning works.
3804	East and Landside Fire Stations	Beijing Urban Construction Group Construction Limited - Beijing Urban Construction International Construction Limited - Kin Shing (Leung's) General Contractors Ltd Joint Venture	The works covered by the Contract 3804 comprise the construction of the East Fire Station (EFS) and Landside Fire Station (LFS), which are three-storey and four storey facilities for supporting firefighting and emergency rescue services at the airport. The major construction activities include without limitation the following: • Construction of EFS and LFS; • Building services and airport systems; • Handling, treatment and reuse of the marine deposit, contaminated mud and treated soil; • All associated testing and commissioning works.
3805	New Airport District Police Operational Base	Chinney Construction Co., Ltd.	The works covered by the Contract 3805 comprise the construction of the New Airport District Police Operational Base (NPOB), which is a seven-storey high building for provision of operational facilities such as a forward holding area and dog kennel for counter terrorism related units, training facilities such as a firing range and a tactics training centre and offices, facilities for district operation and ancillary facilities. The major construction activities include without limitation the following: • Piled foundation works; • Handling, treatment and reuse of the marine deposit, contaminated mud and treated soil; • Associated testing and commissioning works; and • Associated temporary works.
3901A	Concrete Batching Facility	K. Wah Concrete Company Limited	The works covered by the Contract 3901A comprise the establishment, operation and maintenance of a concrete batching facility at the Project Site and the supply of concrete products. The major construction activities include without limitation the following:

Contract No.	Contract Title	Contractor	Key Construction Activities
			- Supply of all equipment for the installation of the Facility to the Site; and - Supply of all raw materials required for the production of ready mixed concrete products and the continual operation of the Facility.
3901B	Concrete Batching Facility	Gammon Construction Limited	The works covered by the Contract 3901B comprise the establishment, operation and maintenance of a concrete batching facility at the Project Site and the supply of concrete products. The major construction activities include without limitation the following: - Supply of all equipment for the installation of Facility to the Site; and - Supply of all raw materials required for the production of ready mixed concrete products and the continual operation of the Facility.
3913	Asphalt Batching Plant	Sinohydro Corporation Limited, Powerchina Airport Construction Company Limited, and Rock-One Engineering Company Limited Joint Venture	The works covered the Contract 3913 comprise the takeover of existing asphalt batching facilities at the Western Support Area, the provision of all other associated facilities, plant and equipment such as bitumen and polymer modified binder blending units (collectively called the Facility) and the operation and maintenance of the Facility. The major construction activities include without limitation the following: - Supply of licenced products required for asphalt pavement work; - Decommissioning and returning works; and - All associated testing and commissioning works.
--	132 kV Cable	CLP Power Hong Kong Limited / Kum Shing (K.F.) Construction Company Limited	The works covered the 132kV Cable layering at the Project Site. The major construction activities include without limitation the following: - Duct installation works; and - Cable trenching and laying works

Appendix B. Project Organization Chart

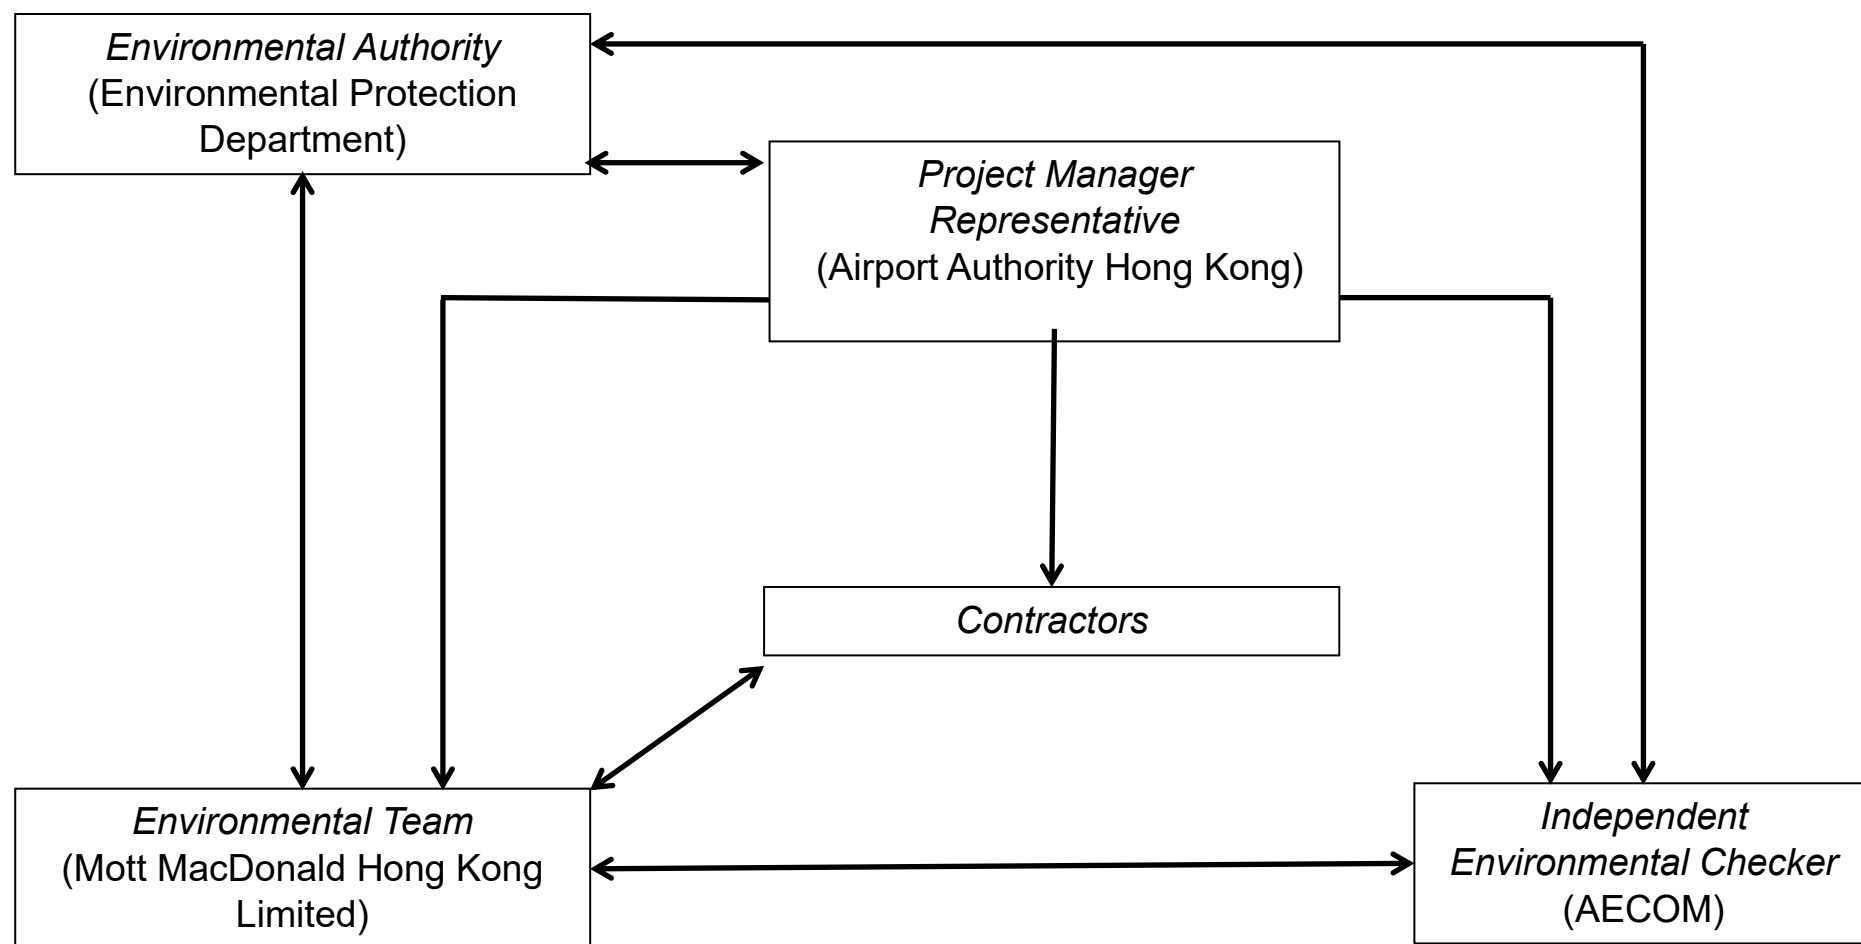

Appendix C. Environmental Mitigation Implementation Schedule (EMIS) for Construction Phase

Environmental Mitigation Implementation Schedule (EMIS) for Construction Phase

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
Air Quality Impact – Construction Phase					
5.2.6.2	2.1	-	Dust Control Measures Water spraying for 12 times a day or once every two hours for 24-hour working at all active works area.	Within construction site / Duration of the construction phase	I
5.2.6.3	2.1	-	Covering of at least 80% of the stockpiling area by impervious sheets. Water spraying of all dusty materials immediately prior to any loading transfer operation so as to keep the dusty material wet during material handling.	Within construction site / Duration of the construction phase	I
5.2.6.4	2.1	-	Dust control practices as stipulated in the Air Pollution Control (Construction Dust) Regulation should be adopted. These practices include: Good Site Management Good site management is important to help reducing potential air quality impact down to an acceptable level. As a general guide, the Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust. Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimise the release of visible dust emission. Any piles of materials accumulated on or around the work areas should be cleaned up regularly. Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimising generation of fugitive dust emissions. The material should be handled properly to prevent fugitive dust emission before cleaning.	Within construction site / Duration of the construction phase	I
			Disturbed Parts of the Roads - Each and every main temporary access should be paved with concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or - Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.	Within construction site / Duration of the construction phase	I
			Exposed Earth Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.	Within construction site / Duration of the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Loading, Unloading or Transfer of Dusty Materials All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.	Within construction site / Duration of the construction phase	I
			Debris Handling - Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides; and - Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.	Within construction site / Duration of the construction phase	I
			Transport of Dusty Materials Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.	Within construction site / Duration of the construction phase	I
			Wheel washing Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.	Within construction site / Duration of the construction phase	I
			Use of vehicles - The speed of the trucks within the site should be controlled to about 10km/hour in order to reduce adverse dust impacts and secure the safe movement around the site; - Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels; and - Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle.	Within construction site / Duration of the construction phase	I
			Site hoarding Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit.	Within construction site / Duration of the construction phase	I
5.2.6.5	2.1	-	Best Practices for Concrete Batching Plant The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Cement Works (Concrete Batching Plant) BPM 3/2 as well as in the future Specified Process licence should be adopted. The best practices are recommended to be applied to both the land based and floating concrete batching plants. Best practices include: Cement and other dusty materials	Within Concrete Batching Plant / Duration of the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			▪ The loading, unloading, handling, transfer or storage of cement, pulverised fuel ash (PFA) and/or other equally dusty materials shall be carried in a totally enclosed system acceptable to EPD. All dust-laden air or waste gas generated by the process operations shall be properly extracted and vented to fabric filtering system to meet the required emission limit; ▪ Cement, PFA and/or other equally dusty materials shall be stored in storage silo fitted with audible high-level alarms to warn of over-filling. The high-level alarm indicators shall be interlocked with the material filling line such that in the event of the silo approaching an overfilling condition, an audible alarm will operate, and after 1 minute or less the material filling line will be closed; ▪ Vents of all silos shall be fitted with fabric filtering system to meet the required emission limit; ▪ Vents of cement/PFA weighing scale shall be fitted with fabric filtering system to meet the required emission limit; and ▪ Seating of pressure relief valves of all silos shall be checked, and the valves re-seated if necessary, before each delivery.		
			Other raw materials ▪ The loading, unloading, handling, transfer or storage of other raw materials which may generate airborne dust emissions such as crushed rock, sand, stone aggregate, shall be carried out in such a manner to prevent or minimize dust emissions; ▪ The materials shall be adequately wetted prior to and during the loading, unloading and handling operations. Manual or automatic water spraying system shall be provided at all unloading areas, stockpiles and material discharge points; ▪ All receiving hoppers for unloading relevant materials shall be enclosed on three sides up to 3 m above the unloading point. In no case shall these hoppers be used as the material storage devices; ▪ The belt conveyor for handling materials shall be enclosed on top and two sides with a metal board at the bottom to eliminate any dust emission due to wind-whipping effect. Other type of enclosure will also be accepted by EPD if it can be demonstrated that the proposed enclosure can achieve same performance; ▪ All conveyor transfer points shall be totally enclosed. Openings for the passage of conveyors shall be fitted with adequate flexible seals; ▪ Scrapers shall be provided at the turning points of all conveyors to remove dust adhered to the belt surface; ▪ Conveyors discharged to stockpiles of relevant materials shall be arranged to minimize free fall as far as practicable. All free falling transfer points from conveyors to stockpiles shall be enclosed with chute(s) and water sprayed;	Within Concrete Batching Plant / Duration of the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- Aggregates with a nominal size less than or equal to 5 mm should be stored in totally enclosed structure such as storage bin and should not be handled in open area. Where there is sufficient buffer area surrounding the concrete batching plant, ground stockpiling may be used; - The stockpile shall be enclosed at least on top and three sides and with flexible curtain to cover the entrance side; - Aggregates with a nominal size greater than 5 mm should preferably be stored in a totally enclosed structure. If open stockpiling is used, the stockpile shall be enclosed on three sides with the enclosure wall sufficiently higher than the top of the stockpile to prevent wind whipping; and - The opening between the storage bin and weighing scale of the materials shall be fully enclosed.		
			Loading of materials for batching - Concrete truck shall be loaded in such a way as to minimise airborne dust emissions. The following control measures shall be implemented: - Pre-mixing the materials in a totally enclosed concrete mixer before loading the materials into the concrete truck is recommended. All dust-laden air generated by the pre-mixing process as well as the loading process shall be totally vented to fabric filtering system to meet the required emission limit; and - If truck mixing batching or other types of batching method is used, effective dust control measures acceptable to EPD shall be adopted. The dust control measures must have been demonstrated to EPD that they are capable to collect and vent all dust-laden air generated by the material loading/mixing to dust arrestment plant to meet the required emission limit. - The loading bay shall be totally enclosed during the loading process.	Within Concrete Batching Plant / Duration of the construction phase	I
			Vehicles - All practicable measures shall be taken to prevent or minimize the dust emission caused by vehicle movement; and - All access and route roads within the premises shall be paved and adequately wetted.	Within Concrete Batching Plant / Duration of the construction phase	I
			Housekeeping A high standard of housekeeping shall be maintained. All spillages or deposits of materials on ground, support structures or roofs shall be cleaned up promptly by a cleaning method acceptable to EPD. Any dumping of materials at open area shall be prohibited.	Within Concrete Batching Plant / Duration of the construction phase	I
5.2.6.6	2.1	-	Best Practices for Asphaltic Concrete Plant The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Tar and Bitumen Works (Asphaltic Concrete Plant) BPM 15 (94) as well as in the future Specified Process licence should be adopted. These include:	Within Asphaltic Concrete Plant / Duration of the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Design of Chimney - The chimney shall not be less than 3 metres plus the building height or 8 metres above ground level, whichever is the greater; - The efflux velocity of gases from the main chimney shall not be less than 12 m/s at full load condition; - The flue gas exit temperature shall not be less than the acid dew point; and - Release of the chimney shall be directed vertically upwards and not be restricted or deflected.		
			Cold feed side - The aggregates with a nominal size less than or equal to 5 mm shall be stored in totally enclosed structure such as storage bin and shall not be handled in open area; - Where there is sufficient buffer area surrounding the plant, ground stockpiling may be used. The stockpile shall be enclosed at least on top and three sides and with flexible curtain to cover the entrance side. If these aggregates are stored above the feeding hopper, they shall be enclosed at least on top and three sides and be wetted on the surface to prevent wind-whipping; - The aggregates with a nominal size greater than 5 mm should preferably be stored in totally enclosed structure. Aggregates stockpile that is above the feeding hopper shall be enclosed at least on top and three sides. If open stockpiling is used, the stockpiles shall be enclosed on three sides with the enclosure wall sufficiently higher than the top of the stockpile to prevent wind whipping; - Belt conveyors shall be enclosed on top and two sides and provided with a metal board at the bottom to eliminate any dust emission due to the wind-whipping effect. Other type of enclosure will also be accepted by EPD if it can be demonstrated that the proposed enclosure can be achieve the same performance; - Scrapers shall be provided at the turning points of all belt conveyors inside the chute of the transfer points to remove dust adhered to the belt surface; - All conveyor transfer points shall be totally enclosed. Openings for the passages of conveyors shall be fitted with adequate flexible seals; and - All materials returned from dust collection system shall be transferred in enclosed system and shall be stored inside bins or enclosures.	Within Asphaltic Concrete Plant / Duration of the construction phase	I
			Hot feed side - The inlet and outlet of the rotary dryer shall be enclosed and ducted to a dust extraction and collection system such as a fabric filter. The particulate and gaseous concentration at the exhaust outlet of the dust collector shall not exceed the required limiting values; - The bucket elevator shall be totally enclosed and the air be extracted and ducted to a dust collection system to meet the required particulates limiting value;	Within Asphaltic Concrete Plant / Duration of the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- All vibratory screens shall be totally enclosed and dust tight with close-fitted access inspection opening. Gaskets shall be installed to seal off any cracks and edges of any inspection openings; - Chutes for carrying hot material shall be rigid and preferably fitted with abrasion resistant plate inside. They shall be inspected daily for leakages; - All hot bins shall be totally enclosed and dust tight with close-fitted access inspection opening. Gaskets shall be installed to seal off any cracks and edges of any inspection openings. The air shall be extracted and ducted to a dust collection system to meet the required particulates limiting value; and - Appropriate control measures shall be adopted in order to meet the required bitumen emission limit as well as the ambient odour level (2 odour units).		
			Material transportation - The loading, unloading, handling, transfer or storage of other raw materials which may generate airborne dust emissions such as crushed rocks, sands, stone aggregates, reject fines, shall be carried out in such a manner as to minimize dust emissions; - Roadways from the entrance of the plant to the product loading points and/or any other working areas where there are regular movements of vehicles shall be paved or hard surfaced; and - Haul roads inside the Works shall be adequately wetted with water and/or chemical suppressants by water trucks or water sprayers.	Within Asphaltic Concrete Plant / Duration of the construction phase	I
			Control of emissions from bitumen decanting - The heating temperature of the particular bitumen type and grade shall not exceed the corresponding temperature limit of the same type listed in Appendix 1 of the Guidance Note; - Tamper-free high temperature cut-off device shall be provided to shut off the fuel supply or electricity in case the upper limit for bitumen temperature is reached; - Proper chimney for the discharge of bitumen fumes shall be provided at high level; - The emission of bitumen fumes shall not exceed the required emission limit; and - The air-to-fuel ratio shall be properly controlled to allow complete combustion of the fuel. The fuel burners, if any, shall be maintained properly and free from carbon deposits in the burner nozzles.	Within Asphaltic Concrete Plant / Duration of the construction phase	I
			Liquid fuel The receipt, handling and storage of liquid fuel shall be carried out so as to prevent the release of emissions of organic vapours and/or other noxious and offensive emissions to the air.	Within Asphaltic Concrete Plant / Duration of the construction phase	I
			Housekeeping	Within Asphaltic Concrete Plant /	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			A high standard of housekeeping shall be maintained. Waste material, spillage and scattered piles gathered beneath belt conveyors, inside and around enclosures shall be cleared frequently. The minimum clearing frequency is on a weekly basis.	Duration of the construction phase	
5.2.6.7	2.1	-	Best Practices for Rock Crushing Plants The relevant best practices for dust control as stipulated in the Guidance Note on the Best Practicable Means for Mineral Works (Stone Crushing Plant) BPM 11/1 (95) as well as in the future Specified Process licence should be adopted. These include: Crushers - The outlet of all primary crushers, and both inlet and outlet of all secondary and tertiary crushers, if not installed inside a reasonably dust tight housing, shall be enclosed and ducted to a dust extraction and collection system such as a fabric filter; - The inlet hopper of the primary crushers shall be enclosed on top and 3 sides to contain the emissions during dumping of rocks from trucks. The rock while still on the trucks shall be wetted before dumping; - Water sprayers shall be installed and operated in strategic locations at the feeding inlet of crushers; and - Crusher enclosures shall be rigid and be fitted with self-closing doors and close-fitting entrances and exits. Where conveyors pass through the crusher enclosures, flexible covers shall be installed at entries and exits of the conveyors to the enclosure. Vibratory screens and grizzlies - All vibratory screens shall be totally enclosed in a housing. Screenhouses shall be rigid and reasonably dust tight with self-closing doors or close-fitted entrances and exits for access. Where conveyors pass through the screenhouse, flexible covers shall be installed at entries and exits of the conveyors to the housing. Where containment of dust within the screenhouse structure is not successful then a dust extraction and collection system shall be provided; and - All grizzlies shall be enclosed on top and 3 sides and sufficient water sprayers shall be installed at their feeding and outlet areas. Belt conveyors - Except for those conveyors which are placed within a totally enclosed structure such as a screenhouse or those erected at the ground level, all conveyors shall be totally enclosed with windshield on top and 2 sides; - Effective belt scraper such as the pre-cleaner blades made by hard wearing materials and provided with pneumatic tensioner, or equivalent device, shall be installed at the head pulley of designated conveyor as required to dislodge fine dust particles that may adhere to the belt surface and to reduce carry-back of fine materials on the return belt. Bottom plates shall also be provided for the conveyor unless it has been	Within Rock Crushing Plant / Duration of the construction phase Within Rock Crushing Plant / Duration of the construction phase Within Rock Crushing Plant / Duration of the construction phase	N/A as there was no rock crushing plant at this stage N/A as there was no rock crushing plant at this stage N/A as there was no rock crushing plant at this stage

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			demonstrated that the corresponding belt scraper is effective and well maintained to prevent falling material from the return belt; and Except for those transfer points which are placed within a totally enclosed structure such as a screenhouse, all transfer points to and from conveyors shall be enclosed. Where containment of dust within the enclosure is not successful, then water sprayers shall be provided. Openings for any enclosed structure for the passage of conveyors shall be fitted with flexible seals.		
			Storage piles and bins - Where practicable, free falling transfer points from conveyors to stockpiles shall be fitted with flexible curtains or be enclosed with chutes designed to minimize the drop height. Water sprays shall also be used where required. - The surface of all surge piles and stockpiles of blasted rocks or aggregates shall be kept sufficiently wet by water spraying wherever practicable; - All open stockpiles for aggregates of size in excess of 5 mm shall be kept sufficiently wet by water spraying where practicable; or - The stockpiles of aggregates 5 mm in size or less shall be enclosed on 3 sides or suitably located to minimize wind-whipping. Save for fluctuations in stock or production, the average stockpile shall stay within the enclosure walls and in no case the height of the stockpile shall exceed twice the height of the enclosure walls; and - Scattered piles gathered beneath belt conveyors, inside and around enclosures shall be cleared regularly.	Within Rock Crushing Plant / Duration of the construction phase	N/A as there was no rock crushing plant at this stage
			Rock drilling equipment Appropriate dust control equipment such as a dust extraction and collection system shall be used during rock drilling activities.	Within Rock Crushing Plant / Duration of the construction phase	N/A as there was no rock crushing plant at this stage
Hazard to Human Life – Construction Phase					
Table 6.40	3.2	-	Precautionary measures should be established to request barges to move away during typhoons.	Construction Site / Construction Period	I
Table 6.40	3.2	-	An appropriate marine traffic management system should be established to minimize risk of ship collision.	Construction Site / Construction Period	I
Table 6.40	3.2	-	Location of all existing hydrant networks should be clearly identified prior to any construction works.	Construction Site / Construction Period	I
Noise Impact – Construction Phase					

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
7.5.6	4.3	-	Good Site Practice Good site practice and noise management can significantly reduce the impact of construction site activities on nearby NSRs. The following package of measures should be followed during each phase of construction: ▪ only well-maintained plant to be operated on-site and plant should be serviced regularly during the construction works; ▪ machines and plant that may be in intermittent use to be shut down between work periods or should be throttled down to a minimum; ▪ plant known to emit noise strongly in one direction, should, where possible, be orientated to direct noise away from the NSRs; ▪ mobile plant should be sited as far away from NSRs as possible; and ▪ material stockpiles and other structures to be effectively utilised, where practicable, to screen noise from on-site construction activities.	Within the Project site / During construction phase / Prior to commencement of operation	I
7.5.6	4.3	-	Adoption of QPME ▪ QPME should be adopted as far as applicable.	Within the Project site / During construction phase / Prior to commencement of operation	I
7.5.6	4.3	-	Use of Movable Noise Barriers ▪ Movable noise barriers should be placed along the active works area and mobile plants to block the direct line of sight between PME and the NSRs.	Within the Project site / During construction phase / Prior to commencement of operation	I
7.5.6	4.3	-	Use of Noise Enclosure/ Acoustic Shed ▪ Noise enclosure or acoustic shed should be used to cover stationary PME such as air compressor and generator.	Within the Project site / During construction phase / Prior to commencement of operation	I
Water Quality Impact – Construction Phase					

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
8.8.1.2 and 8.8.1.3	5.1	2.26	Marine Construction Activities <u>General Measures to be Applied to All Works Areas</u> ▪ Barges or hoppers shall not be filled to a level which will cause overflow of materials or pollution of water during loading or transportation; ▪ Use of Lean Material Overboard (LMOB) systems shall be prohibited; ▪ Excess materials shall be cleaned from the decks and exposed fittings of barges and hopper dredgers before the vessels are moved; ▪ Plants should not be operated with leaking pipes and any pipe leakages shall be repaired quickly; ▪ Adequate freeboard shall be maintained on barges to reduce the likelihood of decks being washed by wave action; ▪ All vessels shall be sized such that adequate clearance is maintained between vessels and the seabed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; ▪ The works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site; and ▪ For ground improvement activities including DCM, the wash water from cleaning of the drilling shaft should be appropriately treated before discharge. The Contractor should ensure the wastewater meets the WPCO/TM requirements before discharge. No direct discharge of contaminated water is permitted. <u>Specific Measures to be Applied to All Works Areas</u> ▪ The daily maximum production rates shall not exceed those assumed in the water quality assessment in the EIA report; ▪ A maximum of 10 % fines content to be adopted for sand blanket and 20 % fines content for marine filling below +2.5 mPD prior to substantial completion of seawall (until end of Year 2017) shall be specified in the works contract document;	Within construction site / Duration of the construction phase	C – Completed in Apr 2022
			▪ An advance seawall of at least 200m to be constructed (comprising either rows of contiguous permanent steel cells completed above high tide mark or partially completed seawalls with rock core to high tide mark and filter layer on the inner side) prior to commencement of marine filling activities;		C – Completed in May 2018
			▪ Closed grab dredger shall be used to excavate marine sediment; ▪ Silt curtains surrounding the closed grab dredger shall be deployed in accordance with the Silt Curtain Deployment Plan; and		C – Marine filling works completed in March 2023 (The arrangement of silt curtain has been modified. The details can be referred to Silt

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			The Silt Curtain Deployment Plan shall be implemented.		Curtain Deployment Plan) C – Completed in Mar 2025 for C7a (All enhanced silt curtain removed since March 2023)
			<u>Specific Measures to be Applied to Land Formation Activities prior to Commencement of Marine Filling Works</u> Double layer 'Type III' silt curtains to be applied around the active eastern works areas prior to commencement of sand blanket laying activities. The silt curtains shall be configured to minimise SS release during ebb tides. A silt curtain efficiency test shall be conducted to validate the performance of the silt curtains;	Within construction site / Duration of the construction phase	C – Marine filling works completed in March 2023 (The arrangement of silt curtain has been modified. The details can be referred to Silt Curtain Deployment Plan)
			Double layer silt curtains to enclose WSRs C7a and silt screens installed at the intake points for both WSR C7a and C8 prior to commencement of construction; and		C – Completed in Mar 2025 for C7a
					C – Completed in Dec 2021 for C8 *(The requirement of silt curtain / screen has been modified. The details can be referred to Silt Curtain Deployment Plan)
			The silt curtains and silt screens should be regularly checked and maintained.		C – Completed in Mar 2025 for C7a (All enhanced silt curtain removed since March 2023)

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			<u>Specific Measures to be Applied to Land Formation Activities during Marine Filling Works</u> Double layer 'Type II' or 'Type III' silt curtains to be applied around the eastern openings between partially completed seawalls prior to commencement of marine filling activities. The silt curtains shall be configured to minimise SS release during ebb tides;	Within construction site / Duration of the construction phase	C – Marine filling works completed in March 2023 (The arrangement of silt curtain has been modified. The details can be referred to Silt Curtain Deployment Plan)
			Double layer silt curtains to be applied at the south-western opening prior to commencement of marine filling activities;		C – Marine filling works completed in March 2023 (The arrangement of silt curtain has been modified. The details can be referred to Silt Curtain Deployment Plan)
			Double layer silt curtain to enclose WSR C7a and silt screens installed at the intake points for both WSR C7a and C8 prior to commencement of marine filling activities; and		C – Completed in Mar 2025 for C7a C – Completed in Dec 2021 for C8 (The requirement of silt curtain / screen has been modified. The details can be referred to Silt Curtain Deployment Plan)
			The silt curtains and silt screens should be regularly checked and maintained.		C – Completed in Mar 2025 for C7a (All enhanced silt curtain removed since March 2023)
			<u>Specific Measures to be Applied to the Field Joint Excavation Works for the Submarine Cable Diversion</u>	Within construction site / Duration of the construction phase	N/A – the field joint excavation works for the

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- Only closed grabs designed and maintained to avoid spillage shall be used and should seal tightly when operated. Excavated materials shall be disposed at designated marine disposal area in accordance with the Dumping at Sea Ordinance (DASO) permit conditions; and - Silt curtains surrounding the closed grab dredger to be deployed as a precautionary measure.		submarine cable diversion will no longer be conducted anymore
8.8.1.4	5.1	-	Modification of the Existing Seawall Silt curtains shall be deployed around the seawall modification activities to completely enclose the active works areas, and care should be taken to avoid splashing of rockfill / rock armour into the surrounding marine environment. For the connecting sections with the existing outfalls, works for these connection areas should be undertaken during the dry season in order that individual drainage culvert cells may be isolated for interconnection works.	At the existing northern seawall / Duration of the construction phase	N/A – no marine-based seawall modification works undertaken after land formation.
8.8.1.5	5.1	-	Construction of New Stormwater Outfalls and Modifications to Existing Outfalls During operation of the temporary drainage channel, runoff control measures such as bunding or silt fence shall be provided on both sides of the channel to prevent accumulation and release of SS via the temporary channel. Measures should also be taken to minimise the ingress of site drainage into the culvert excavations.	Within construction site / Duration of the construction phase	I
8.8.1.6 8.8.1.7	5.1	2.27	Piling Activities for Construction of New Runway Approach Lights and HKIAAA Marker Beacons Silt curtains shall be deployed around the piling activities to completely enclose the piling works and care should be taken to avoid spillage of excavated materials into the surrounding marine environment.	Within construction site / Duration of the construction phase	C – For approach lights N/A for marker beacons as HKIAAA Marker Beacons would be replaced by buoys
For construction of the eastern approach lights at the CMPs - Ground improvement via DCM using a close-spaced layout shall be completed prior to commencement of piling works; - Steel casings shall be installed to enclose the excavation area prior to commencement of excavation; - The excavated materials shall be removed using a closed grab within the steel casings; - No discharge of the cement mixed materials into the marine environment will be allowed; and - Excavated materials shall be treated and reused on-site.					C – Completed in Oct 2021

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
8.8.1.8	5.1	-	Construction of Site Runoff and Drainage The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended: ▪ Install perimeter cut-off drains to direct off-site water around the site and implement internal drainage, erosion and sedimentation control facilities. Channels, earth bunds or sandbag barriers should be provided on site to direct storm water to silt removal facilities. The design of the temporary on-site drainage system should be undertaken by the Contractors prior to the commencement of construction (for works areas located on the existing Airport island) or as soon as the new land is completed (for works areas located on the new landform); ▪ Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM-DSS standards under the WPCO. The design of efficient silt removal facilities should make reference to the guidelines in Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the Contractors prior to the commencement of construction; ▪ All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly; ▪ Measures should be taken to minimize the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from foundation excavations should be discharged into storm drains via silt removal facilities; ▪ In the event that contaminated groundwater is identified at excavation areas, this should be treated on-site using a suitable wastewater treatment process. The effluent should be treated according to the requirements of the TM-DSS standards under the WPCO prior to discharge to foul sewers or collected for proper disposal off-site. No direct discharge of contaminated groundwater is permitted; and ▪ All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exits. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. All washwater should be treated according to the requirements of the TM-DSS standards under the WPCO prior to discharge.	Within construction site / Duration of the construction phase	I I I I I I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the construction materials, soil, silt or debris from washing away into the drainage system;		I
			Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and to prevent stormwater runoff being directed into foul sewers; and		I
			Precautionary measures should be taken at any time of the year when rainstorms are likely. Actions to be taken when a rainstorm is imminent or forecasted are summarized in Appendix A2 of ProPECC Note PN 1/94. This includes actions to be taken during and/or after rainstorms. Particular attention should be paid to the control of silty surface runoff during storm events.		I
8.8.1.9	5.1	-	Sewage Effluent from Construction Workforce Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	Within construction site / During construction phase	I
8.8.1.10 8.8.1.11	5.1		General Construction Activities - Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby storm water drain. Stockpiles of cement and other construction materials should be kept covered when not being used; and - Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby storm water drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event.	Within construction site / During construction phase	I
8.8.1.12 8.8.1.13	5.1	2.28	Drilling Activities for the Submarine Aviation Fuel Pipelines To prevent potential water quality impacts at Sha Chau, the following measures shall be applied: - A 'zero-discharge' policy shall be applied for all activities to be conducted at Sha Chau; - No bulk storage of chemicals shall be permitted; and - A containment pit shall be constructed around the drill holes. This containment pit shall be lined with impermeable lining and bunded on the outside to prevent inflow from off-site areas. At the airport island side of the drilling works, the following measures shall be applied for treatment of wastewater: - During pipe cleaning, appropriate desilting or sedimentation device should be provided on site for treatment before discharge. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge; and	Within construction site / During construction phase	C – Completed in Jan 2019
			At the airport island side of the drilling works, the following measures shall be applied for treatment of wastewater: During pipe cleaning, appropriate desilting or sedimentation device should be provided on site for treatment before discharge. The Contractor should ensure discharge water from the sedimentation tank meet the WPCO/TM requirements before discharge; and	Within construction site / During construction phase	C – Completed in Jan 2019

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			Drilling fluid used in drilling activities should be reconditioned and reused as far as possible. Temporary enclosed storage locations should be provided on-site for any unused chemicals that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.		
			Waste Management Implication – Construction Phase		
10.5.1.1	7.1	-	Opportunities to minimise waste generation and maximise the reuse of waste materials generated by the project have been incorporated where possible into the planning, design and construction stages, and the following measures have been recommended: - The relevant construction methods (particularly for the tunnel works) and construction programme have been carefully planned and developed to minimise the extent of excavation and to maximise the on-site reuse of inert C&D materials generated by the project as far as practicable. Temporary stockpiling areas will also be provided to facilitate on-site reuse of inert C&D materials; - Priority should be given to collect and reuse suitable inert C&D materials generated from other concurrent projects and the Government's PFRF as fill materials for the proposed land formation works; - Only non-dredged ground improvement methods should be adopted in order to completely avoid the need for dredging and disposal of marine sediment for the proposed land formation work; - Excavation work for constructing the APM tunnels, BHS tunnels and airside tunnels will not be down to the CMPs beneath the fill materials in order to avoid excavating any sediments; and - For the marine sediments expected to be excavated from the piling works of TRC, APM & BHS tunnels, airside tunnels and other facilities on the proposed land formation area, piling work of marine sections of the approach lights and HKIAAA beacons, basement works for some of T2 expansion area and excavation works for the proposed APM depot should be treated and reused on-site as backfilling materials, although required treatment level / detail and the specific re-use mode are under development.	Project Site Area / During design and construction phase	I C – Completed in first quarter of 2023 for land formation C – Completed in first quarter of 2023 for land formation C – Completed in first quarter of 2025 I
10.5.1.1	7.1	-	The following good site practices should be performed during the construction activities include: - Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site; - Training of site personnel in proper waste management and chemical waste handling procedures;	Project Site Area / Construction Phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- Provision of sufficient waste disposal points and regular collection for disposal; - Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks by tarpaulin/ similar material or by transporting wastes in enclosed containers. The cover should be extended over the edges of the sides and tailboards; - Stockpiles of C&D materials should be kept wet or covered by impervious sheets to avoid wind-blown dust; - All dusty materials including C&D materials should be sprayed with water immediately prior to any loading transfer operation so as to keep the dusty material wet during material handling at the barging points/ stockpile areas; - C&D materials to be delivered to and from the project site by barges or by trucks should be kept wet or covered to avoid wind-blown dust; - The speed of the trucks including dump trucks carrying C&D or waste materials within the site should be controlled to about 10 km/hour in order to reduce the adverse dust impact and secure the safe movement around the site; and - To avoid or minimise dust emission during transport of C&D or waste materials within the site, each and every main temporary access should be paved with concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials. Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.		
10.5.1.3	7.1	-	The following practices should be performed to achieve waste reduction include: - Use of steel or aluminium formworks and falseworks for temporary works as far as practicable; - Adoption of repetitive design to allow reuse of formworks as far as practicable; - Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; - Encourage collection of aluminium cans, PET bottles and paper by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the work force; - Any unused chemicals or those with remaining functional capacity should be collected for reused as far as practicable; - Proper storage and site practices to minimise the potential for damage or contamination of construction materials; and - Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	Project Site Area / Construction Phase	I
10.5.1.5	7.1		Inert and non-inert C&D materials should be handled and stored separately to avoid mixing the two types of materials.	Project Site Area / Construction Phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
10.5.1.5	7.1	-	Any recyclable materials should be segregated from the non-inert C&D materials for collection by reputable licensed recyclers whereas the non-recyclable waste materials should be disposed of at the designated landfill site by a reputable licensed waste collector.	Project Site Area / Construction Phase	I
10.5.1.6	7.1	-	A trip-ticket system promulgated shall be developed in order to monitor the off-site delivery of surplus inert C&D materials that could not be reused on-site for the proposed land formation work at the PFRF and to control fly tipping.	Project Site Area / Construction Phase	I
10.5.1.6	7.1	2.32	The Contractor should prepare and implement a Waste Management Plan detailing various waste arising and waste management practices.	Construction Phase	I
10.5.1.16	7.1	-	The following mitigation measures are recommended during excavation and treatment of the sediments:	Project Site Area / Construction Phase	I
			▪ On-site remediation should be carried out in an enclosed area in order to minimise odour/dust emissions;		I
			▪ The loading, unloading, handling, transfer or storage of treated and untreated sediment should be carried out in such a manner to prevent or minimise dust emissions;		I
			▪ All practical measures, including but not limited to speed control for vehicles, should be taken to minimise dust emission;		I
			▪ Good housekeeping should be maintained at all times at the sediment treatment facility and storage area;		I
			▪ Treated and untreated sediment should be clearly separated and stored separately; and		I
10.5.1.18	7.1	-	▪ Surface runoff from the enclosed area should be properly collected and stored separately, and then properly treated to levels in compliance with the relevant effluent standards as required by the Water Pollution Control Ordinance before final discharge.	Project Site Area / Construction Phase	N/A – the field joint excavation works for the submarine cable diversion will no longer be conducted anymore
			The marine sediments to be removed from the cable field joint area would be disposed of at the designated disposal sites to be allocated by the MFC. The following mitigation measures should be strictly followed to minimise potential impacts on water quality during transportation of the sediments requiring Type 1 disposal:		
			▪ Bottom opening of barges shall be fitted with tight fitting seals to prevent leakage of material;		
			▪ Monitoring of the barge loading shall be conducted to ensure that loss of material does not take place during transportation. Transport barges or vessels shall be equipped with automatic self-monitoring devices as specified by EPD; and		
10.5.1.19	7.1	-	▪ Barges or hopper barges shall not be filled to a level that would cause the overflow of materials or sediment laden water during loading or transportation.	Project Site Area / Construction Phase	I
			Contractor should register with the EPD as a chemical waste producer and to follow the relevant guidelines. The following measures should be implemented:		
			▪ Good quality containers compatible with the chemical wastes should be used;		

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- Incompatible chemicals should be stored separately; - Appropriate labels must be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc.; and - The contractor will use a licensed collector to transport and dispose of the chemical wastes at the approved Chemical Waste Treatment Centre or other licensed recycling facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.		
10.5.1.20	7.1	-	General refuse should be stored in enclosed bins or compaction units separated from inert C&D material. A reputable waste collector should be employed by the contractor to remove general refuse from the site for disposal at designated landfill sites. An enclosed and covered area should be provided to reduce the occurrence of 'windblown' light material.	Project Site Area / Construction Phase	I
10.5.1.21	7.1	-	The construction contractors will be required to regularly check and clean any refuse trapped or accumulated along the newly constructed seawall. Such refuse will then be stored and disposed of together with the general refuse.	Project Site Area / Construction Phase	I
Land Contamination – Construction Phase					
11.10.1.2 to 11.10.1.3	8.1	2.32	For areas inaccessible during site reconnaissance survey Further site reconnaissance would be conducted once the areas are accessible in order to identify any land contamination concern for the areas.	Project Site Area inaccessible during site reconnaissance / Prior to Construction Phase	I
			Subject to further site reconnaissance findings, a supplementary Contamination Assessment Plan (CAP) for additional site investigation (SI) (if necessary) may be prepared and submitted to EPD for endorsement prior to the commencement of SI at these areas.		C – Completed in Jan 2018 (The site re-appraisal summary report for fire training facility was submitted to EPD.)
			After completion of SI, the Contamination Assessment Report (CAR) will be prepared and submitted to EPD for approval prior to start of the proposed construction works at the golf course, the underground and		I *(CAR for golf course and Terminal 2

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			above-ground fuel storage tank areas, emergency power generation units, airside petrol filling station and fuel tank room. Should remediation be required, Remediation Action Plan (RAP) and Remediation Report (RR) will be prepared for EPD's approval prior to commencement of the proposed remediation and any construction works respectively.		emergency power supply system nos.1, 2, 3, 4 and 5 were submitted to EPD) N/A as no remediation was required.
11.8.1.2	8.1	-	If contaminated soil is identified, the following mitigation measures are for the excavation and transportation of contaminated materials (if any): - To minimize the incidents of construction workers coming in contact with any contaminated materials, bulk earth-moving excavation equipment should be employed; - Contact with contaminated materials can be minimised by wearing appropriate clothing and personal protective equipment such as gloves and masks (especially when working directly with contaminated material), provision of washing facilities and prohibition of smoking and eating on site; - Stockpiling of contaminated excavated materials on site should be avoided as far as possible; - The use of any contaminated soil for landscaping purpose should be avoided unless pre-treatment was carried out; - Vehicles containing any excavated materials should be suitably covered to reduce dust emissions and/or release of contaminated wastewater; - Truck bodies and tailgates should be sealed to prevent any discharge; - Only licensed waste haulers should be used to collect and transport contaminated material to treatment/disposal site and should be equipped with tracking system to avoid fly tipping; - Speed control for trucks carrying contaminated materials should be exercised. 8km/h is the recommended speed limit; - Strictly observe all relevant regulations in relation to waste handling, such as Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 354) and obtain all necessary permits where required; and - Maintain records of waste generation and disposal quantities and disposal arrangements.	Project Site Area / Construction Phase	N/A as no contaminated soil was found.
Terrestrial Ecological – Construction Phase					
12.10.1.1	9.2	2.14	Pre-construction Egretty Survey Conduct ecological survey for Sha Chau egretty to update the latest boundary of the egretty.	Breeding season (April - July) prior to commencement of	C – Completed in Jan 2019

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
				HDD drilling works at HKIA	
12.7.2.3 and 12.7.2.6	9.1	2.30	Avoidance and Minimisation of Direct Impact to Egret - The daylighting location will avoid direct encroachment to the Sheung Sha Chau egret. The daylighting location and mooring of flat top barge, if required, will be kept away from the egret; - In any event, controls such as demarcation of construction site boundary and confining the lighting within the site will be practised to minimise disturbance to off-site habitat at Sheung Sha Chau Island; and - The containment pit at the daylighting location shall be covered or camouflaged.	During construction phase at Sheung Sha Chau Island	C – Completed in Jan 2019
12.7.2.5	9.1	2.30	Preservation of Nesting Vegetation The proposed daylighting location and the arrangement of connecting pipeline will avoid the need of tree cutting, therefore the trees that are used by ardeids for nesting will be preserved.	During construction phase at Sheung Sha Chau Island	C – Completed in Jan 2019
12.7.2.4 and 12.7.2.6	9.1	2.30	Timing the Pipe Connection Works outside Ardeid's Breeding Season All HDD and related construction works on Sheung Sha Chau Island will be scheduled outside the ardeids' breeding season (between April and July). No night-time construction work will be allowed on Sheung Sha Chau Island during all seasons.	During construction phase at Sheung Sha Chau Island	C – Completed in Jan 2019
12.10.1.1	9.3	-	Ecological Monitoring During the HDD construction works period from August to March, ecological monitoring will be undertaken monthly at the HDD daylighting location on Sheung Sha Chau Island to identify and evaluate any impacts with appropriate actions taken as required to address and minimise any adverse impact found.	at Sheung Sha Chau Island	C – Completed in Jan 2019
Marine Ecological Impact – Pre-construction Phase					
13.11.4.1	10.2.2	-	Pre-construction phase Coral Dive Survey.	HKIAA artificial seawall	C – Completed in Jan 2016
Marine Ecological Impact – Construction Phase					
13.11.1.3 to 13.11.1.6	-	-	Minimisation of Land Formation Area Minimise the overall size of the land formation needed for the additional facilities to minimise the overall loss of habitat for marine resources, especially the CWD population.	Land formation footprint / during detailed design phase to completion of construction	C – Completed in first quarter of 2023 for land formation works
13.11.1.7 to 13.11.1.10	-	2.31	Use of Construction Methods with Minimal Risk/Disturbance Use of non-dredge method for the main land formation and ancillary works including the diversion of the aviation fuel pipeline to the AFRF;	During construction phase at marine works area	C – Completed in Jan 2019 for diversion of

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- Use of Deep Cement Mixing (DCM) method instead of conventional seabed dredging for the land formation works to reduce the risk of negative impacts through the elevation of suspended solids and contaminants on CWDs, fisheries and the marine environment; - Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; - Avoid bored piling during CWD peak calving season (Mar to Jun); - Prohibition of underwater percussive piling; and - Use of horizontal directional drilling (HDD) method and water jetting methods for placement of submarine cables and pipelines to minimise the disturbance to the CWDs and other marine ecological resources.		aviation fuel pipeline C – Completed in Apr 2022 C – Completed in Oct 2021 for new approach lights N/A for marker beacons as HKIAAAA Marker Beacons would be replaced by buoys N/A as no underwater piling works C – Completed in Jan 2019 for HDD works
13.11.2.1 to 13.11.2.7	-	-	Mitigation for Indirect Disturbance due to Deterioration of Water Quality - Water quality mitigation measures during construction phases include consideration of alternative construction methods, deployment of silt curtain and good site practices; - Alternative construction methods including use of non-dredge methods for ground improvement (e.g. Deep Cement Mixing (DCM), prefabricated vertical drains (PVD), sand compaction piles, steel cells, stone columns and vertical sand drains); - Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; and - Use of horizontal directional drilling (HDD) method and water jetting methods for placement of undersea cables and pipelines to minimise the disturbance to the CWDs and other marine ecological resources.	All works area during the construction phase	I C – Completed in Apr 2022 C – Completed in Oct 2021 for new approach lights C – Completed in Jan 2019 for HDD works
13.11.1.12	-	-	Strict Enforcement of No-Dumping Policy	All works area during the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			▪ A policy prohibiting dumping of wastes, chemicals, oil, trash, plastic, or any other substance that would potentially be harmful to dolphins and/or their habitat in the work area; ▪ Mandatory educational programme of the no-dumping policy be made available to all construction site personnel for all project-related works; ▪ Fines for infractions should be implemented; and ▪ Unscheduled, on-site audits shall be implemented.		
13.11.1.13	-	-	Good Construction Site Practices ▪ Regular inspection of the integrity and effectiveness of all silt curtains and monitoring of effluents to ensure that any discharge meets effluent discharge guidelines; ▪ Keep the number of working or stationary vessels present on-site to the minimum anytime; and ▪ Unscheduled, on-site audits for all good site practice restrictions should be conducted, and fines or penalties sufficient to be an effective deterrent need to be levied against violators.	All works area during the construction phase	I
13.11.1.3 to 13.11.1.6	-	-	Minimisation of Land Formation Area ▪ Minimise the overall size of the land formation needed for the additional facilities to minimise the overall loss of habitat for marine resources, especially the CWD population.	Land formation footprint / during detailed design phase to completion of construction	C – Completed in first quarter of 2023 for land formation
13.11.5.4 to 13.11.5.13	10.3.1	-	SkyPier High Speed Ferries' Speed Restrictions and Route Diversions ▪ SkyPier HSFs operating to / from Zhuhai and Macau would divert north of SCLKC Marine Park with a 15 knot speed limit to apply for the part-journeys that cross high CWD abundance grid squares as indicatively shown in Drawing No. MCL/P132/EIA/13-023 of the EIA Report. Both the alignment of the northerly route and the portion of routings to be subject to the speed limit of 15 knots shall be finalised prior to commencement of construction based on the future review of up-to-date CWD abundance and EM&A data and taking reference to changes in total SkyPier HSF numbers; and ▪ A maximum of 10 knots will be enforced through the designated SCLKC Marine Park area at all times.	Area between the footprint and SCLKC Marine Park during construction phase	I
			Other mitigation measures ▪ The ET will audit various parameters including actual daily numbers of HSFs, compliance with the 15-knot speed limit in the speed control zone and diversion compliance for SkyPier HSFs operating to / from Zhuhai and Macau; and ▪ The effectiveness of the CWD mitigation measures after implementation of initial six month SkyPier HSF diversion and speed restriction will be reviewed.	Area between the footprint and SCLKC Marine Park during construction phase	I (Audit on Annual daily average limit and maximum daily movement cap were ceased after the designation of NLMP)

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
13.11.5.14 to 13.11.5.18	10.3.1	2.31	Dolphin Exclusion Zone Establishment of a 24 hr Dolphin Exclusion Zone (DEZ) with a 250 m radius around the land formation works areas;	Marine waters around land formation works area during construction phase	C – Completed in Sep 2016 C – Completed in the first Quarter of 2023 for the land formation works
			- A DEZ would also be implemented during ground improvement works (e.g. DCM), water jetting works for submarine cables diversion, open trench dredging at the field joint locations and seawall construction; and - A DEZ would also be implemented during bored piling work but as a precautionary measure only.		C – Completed in Apr 2022 C – Completed in Oct 2021 for the bored piling work of New approach lights
13.11.5.19	10.4	2.31	Acoustic Decoupling of Construction Equipment - Air compressors and other noisy equipment that must be mounted on steel barges should be acoustically-decoupled to the greatest extent feasible, for instance by using rubber or air-filled tyres; and - Specific acoustic decoupling measures shall be specified during the detailed design of the project for use during the land formation works.	Around coastal works area during construction phase	I
13.11.5.20	10.6.1	2.29	Spill Response Plan An oil and hazardous chemical spill response plan is proposed to be established during the construction phase as a precautionary measure so that appropriate actions to prevent or reduce risks to CWDs can be undertaken in the event of an accidental spillage.	Construction phase	I
13.11.5.21 to 13.11.5.23	10.6.1	-	Construction Vessel Speed Limits and Skipper Training - A speed limit of 10 knots should be strictly observed for construction vessels at areas with the highest CWD densities (as currently indicated by the 1x1km grid squares in Figure 6 of Appendix 13.2 of EIA report). - Vessels traversing through the work areas should be required to use predefined and regular routes (which would presumably become known to resident dolphins) to reduce disturbance to cetaceans due to vessel movements. Specific marine routes shall be specified by the Contractor prior to construction commencing.	All areas north and west of Lantau Island during construction phase	I
Fisheries Impact – Construction Phase					

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
14.9.1.2 to 14.9.1.5	-		Minimisation of Land Formation Area Minimise the overall size of the land formation needed for the additional facilities to minimise the overall loss of habitat for fisheries resources.	Land formation footprint / during detailed design phase to completion of construction	C – Completed in first quarter of 2023 for land formation works
14.9.1.6	-	-	Use of Construction Methods with Minimal Risk/Disturbance Use of non-dredge method for the main land formation and ancillary works including the diversion of the aviation fuel pipeline to the AFRF;	During construction phase at marine works area	C – Completed in Jan 2019 for diversion of aviation fuel pipeline
			Use of Deep Cement Mixing (DCM) method instead of conventional seabed dredging for the land formation works to reduce the risk of negative impacts through the elevation of suspended solids and contaminants on fisheries and the marine environment;		C – Completed in Apr 2022
			Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; and		C – Completed in Oct 2021 for new approach lights N/A for marker beacons as HKIAAA Marker Beacons would be replaced by buoys
			Use of horizontal directional drilling (HDD) method and water jetting methods for placement of undersea cables and pipelines to minimise the disturbance to fisheries resources.		C – Completed in Jan 2019 for HDD works
14.9.1.11	-		Strict Enforcement of No-Dumping Policy - A policy prohibiting dumping of wastes, chemicals, oil, trash, plastic, or any other substance that would potentially be harmful to dolphins and/or their habitat in the work area; - Mandatory educational programme of the no-dumping policy be made available to all construction site personnel for all project-related works; - Fines for infractions should be implemented; and - Unscheduled, on-site audits shall be implemented.	All works area during the construction phase	I
14.9.1.12	-		Good Construction Site Practices	All works area during the construction phase	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
			- Regular inspection of the integrity and effectiveness of all silt curtains and monitoring of effluents to ensure that any discharge meets effluent discharge guidelines; - Keep the number of working or stationary vessels present on-site to the minimum anytime; and - Unscheduled, on-site audits for all good site practice restrictions should be conducted, and fines or penalties sufficient to be an effective deterrent need to be levied against violators.		
14.9.1.13 to 14.9.1.18	-		Mitigation for Indirect Disturbance due to Deterioration of Water Quality - Water quality mitigation measures during construction phases include consideration of alternative construction methods, deployment of silt curtain and good site practices; - Alternative construction methods including use of non-dredge methods for ground improvement (e.g. Deep Cement Mixing (DCM), prefabricated vertical drains (PVD), sand compaction piles, steel cells, stone columns and vertical sand drains); - Use of bored piling in short duration to form the new approach lights and marker beacons for the new runway; and	All works area during the construction phase	I C – Completed in Apr 2022 C – Completed in Oct 2021 for new approach lights N/A for marker beacons as HKIAAAA Marker Beacons would be replaced by buoys C – Completed on Jan 2019 for HDD work
Landscape and Visual Impact – Construction Phase					
Table 15.6	12.3	-	CM1 - The construction area and contractor's temporary works areas should be minimised to avoid impacts on adjacent landscape.	All works areas for duration of works; Upon handover and completion of works.	I
Table 15.6	12.3	-	CM2 - Reduction of construction period to practical minimum.	All works areas for duration of works; Upon handover and completion of works.	I
Table 15.6	12.3	-	CM3 - Phasing of the construction stage to reduce visual impacts during the construction phase.	All works areas for duration of works;	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
				Upon handover and completion of works.	
Table 15.6	12.3	-	CM4 - Construction traffic (land and sea) including construction plants, construction vessels and barges should be kept to a practical minimum.	All works areas for duration of works; Upon handover and completion of works.	I
Table 15.6	12.3	-	CM5 - Erection of decorative mesh screens or construction hoardings around works areas in visually unobtrusive colours.	All works areas for duration of works; Upon handover and completion of works. – may be disassembled in phases.	I
Table 15.6	12.3	-	CM6 - Avoidance of excessive height and bulk of site buildings and structures.	New passenger concourse, terminal 2 expansion and other proposed airport related buildings and structures under the project; Upon handover and completion of works.	I
Table 15.6	12.3	-	CM7 - Control of night-time lighting by hooding all lights and through minimisation of night working periods.	All works areas for duration of works; Upon handover and completion of works. – may be disassembled in phases.	I
Table 15.6	12.3	-	CM8 - All existing trees shall be carefully protected during construction. Detailed Tree Protection Specification shall be provided in the Contract Specification. Under this specification, the Contractor shall be required to submit, for approval, a detailed working method statement for the protection of trees prior to undertaking any works adjacent to all retained trees, including trees in contractor's works areas.	All existing trees to be retained; Upon handover and completion of works.	I
Table 15.6	12.3	-	CM9 - Trees unavoidably affected by the works shall be transplanted where practical. A detailed Tree Transplanting Specification shall be provided in the Contract Specification, if applicable. Sufficient time for necessary tree root and crown preparation periods shall be allowed in the project programme.	All existing trees to be affected by the works;	I

EIA Ref.	EM&A Ref.	EP Condition	Environmental Protection Measures	Location / Duration of measures Timing of completion of measures	Mitigation Measures Implemented?^
Table 15.6	12.3	-	CM10 - Land formation works shall be followed with advanced hydroseeding around taxiways and runways as soon as practical.	Upon handover and completion of works. All affected existing grass areas around runways and verges/Duration of works; Upon handover and completion of works.	I
Cultural Heritage Impact – Construction Phase					
Not applicable to the construction stage of this project.					
Health Impact – Aircraft Emissions					
Not applicable to the construction stage of this project.					
Health Impact – Aircraft Noise					
Not applicable to the construction stage of this project.					

Notes:

“ - ” For items denoted as “ - ” provided under the columns of EM&A Ref. or EP Condition, environmental protection measures should be referred to the relevant paragraph(s) / table(s) in the approved EIA Report.

“ I ” Implemented and on-going where applicable.


“ N/A ” Not applicable to the construction works implemented during the reporting month.

“ ^ ” Checked by ET through site inspection and record provided by the Contractor.

“C” Construction works completed.

Appendix D. Monitoring Results


Air Quality Monitoring Results

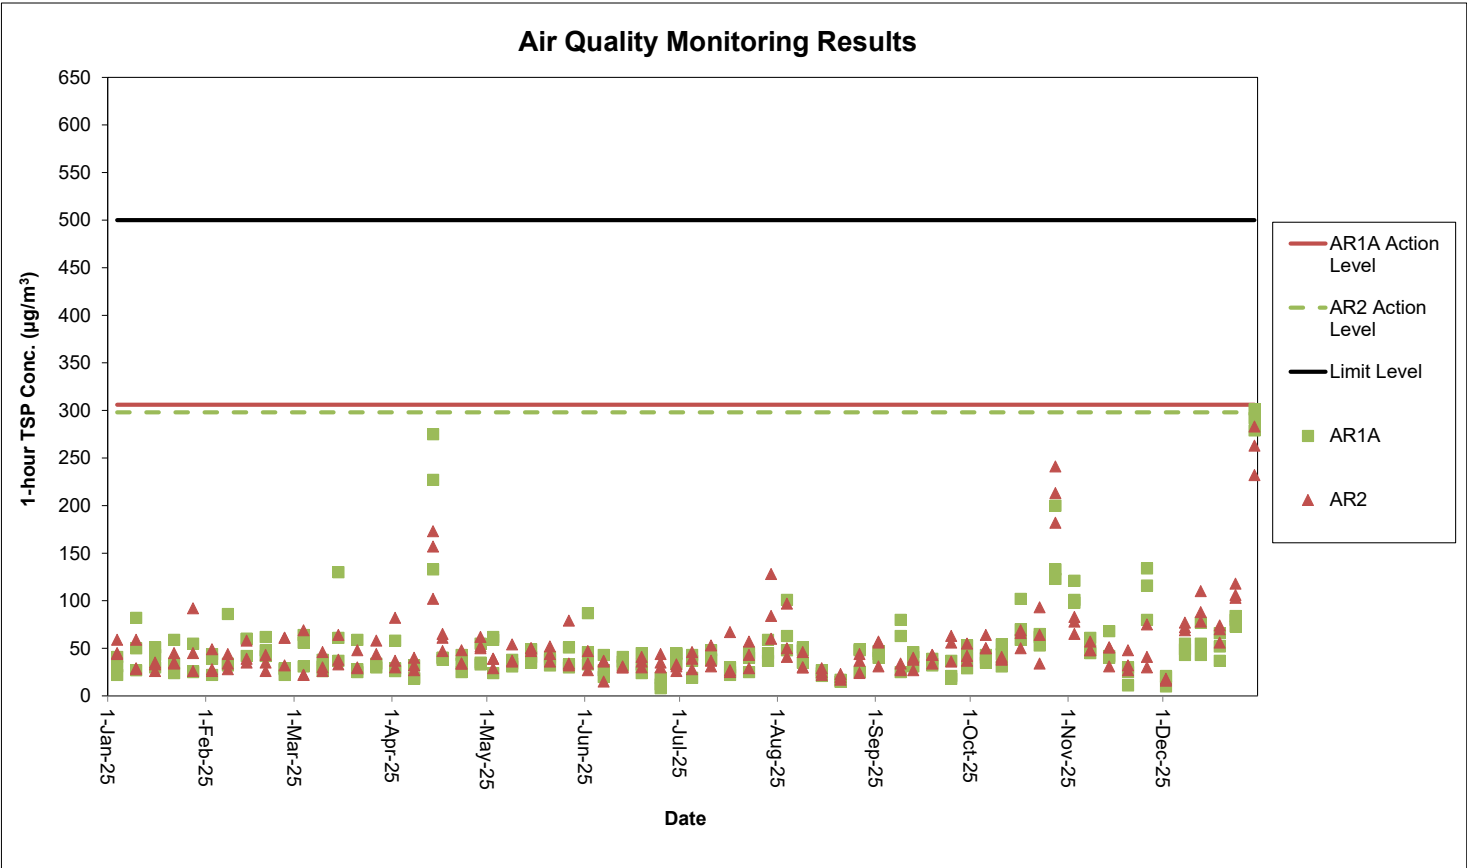

Notes

1. The key activities of the Project carried out in the reporting period are located in reclamation areas and existing airport island respectively. Works in the reclamation areas included rock armour laying works, filling and ground improvement works, pavement works, Terminal 2 concourse superstructure works, tunnel works for Automated People Mover (APM) and Baggage Handling System (BHS) and works on existing airport island involved mainly Terminal 2 expansion works, modification and tunnel works for APM and BHS, and preparation works for utilities, with activities including road and drainage works, electrical and mechanical works and 132kV cable laying works.
2. General weather condition during monitoring ranged from sunny to overcast. Detailed meteorological conditions should be referred to Table 2.3 of this Report and corresponding Monthly EM&A Reports.
3. QA/ QC requirements as stipulated in the EM&A Manual was carried out during measurement.

Noise Monitoring Results

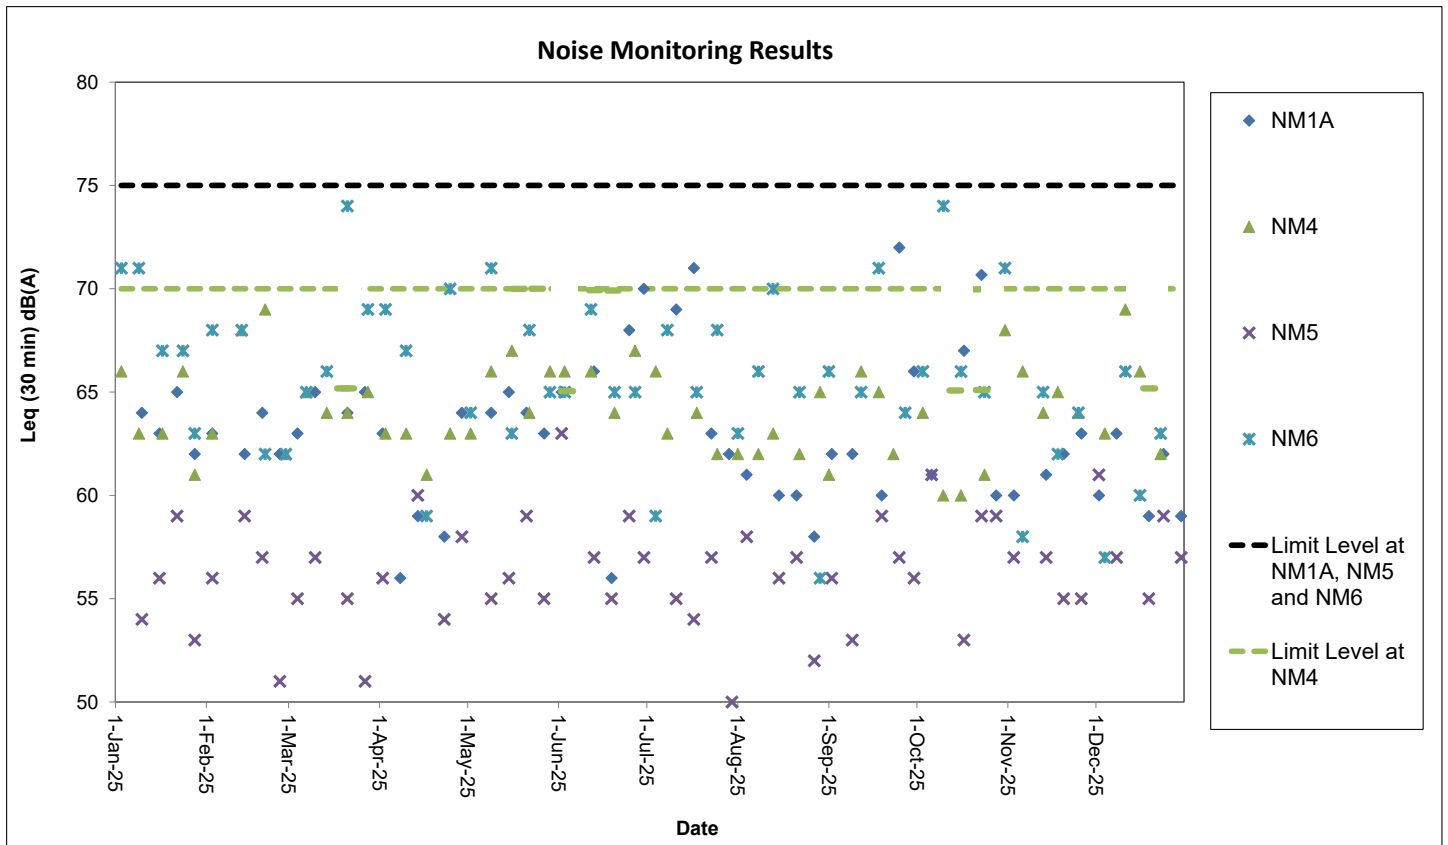

Notes

1. The Limit Level is reduced to 70dB(A) for school and 65db(A) during school examination period at NM4. School examination took place from 17 to 21 March, 4 to 10 June, 20 to 24 October, and 3 to 10 December during this reporting period.
2. Noise monitoring at NM3A was temporarily suspended starting from 1 Sep 2018 and would be resumed with the completion of the Tung Chung East Development.
3. The key activities of the Project carried out in the reporting period are located in reclamation areas and existing airport island respectively. Works in the reclamation areas included rock armour laying works, filling and ground improvement works, pavement works, Terminal 2 concourse superstructure works, tunnel works for Automated People Mover (APM) and Baggage Handling System (BHS) and works on existing airport island involved mainly Terminal 2 expansion works, modification and tunnel works for APM and BHS, and preparation works for utilities, with activities including road and drainage works, electrical and mechanical works and 132kV cable laying works.
4. General weather condition during monitoring ranged from sunny to drizzle. Detailed meteorological conditions should be referred to Table 2.6 of this Report and corresponding Monthly EM&A Reports.
5. QA/ QC requirements as stipulated in the EM&A Manual was carried out during measurement.

Appendix E. Chinese White Dolphin Monitoring Results

Figure 1: Sightings Distribution of Chinese White Dolphins in 2025

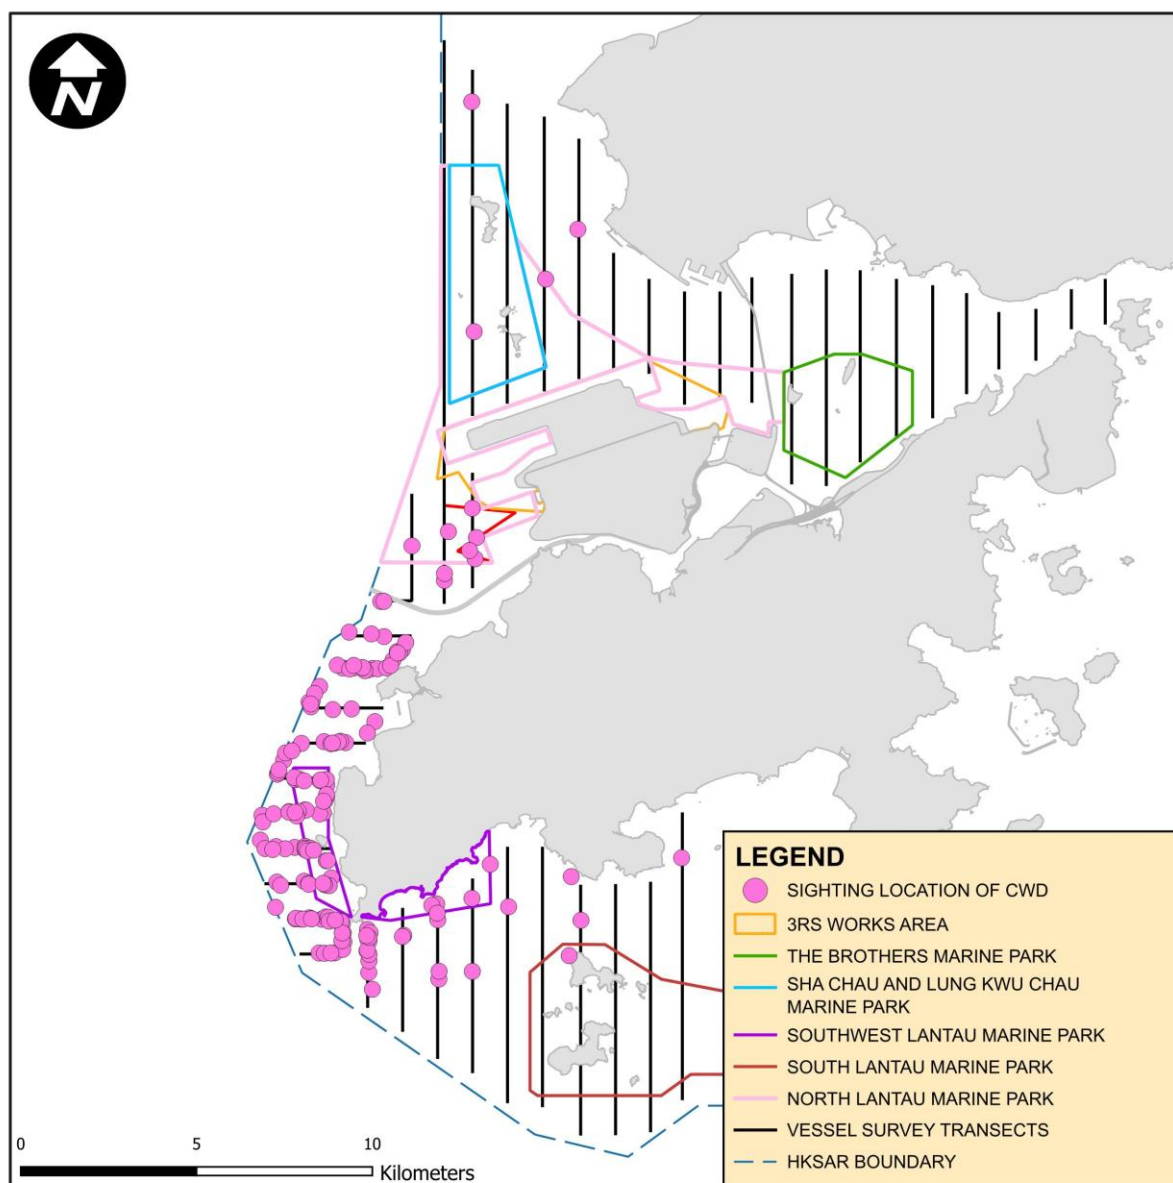


Figure 2: Fitted Detection Function of the 2025 CWD Sightings, Pooled from All Western Hong Kong Survey Areas (truncation distance = 375 m)



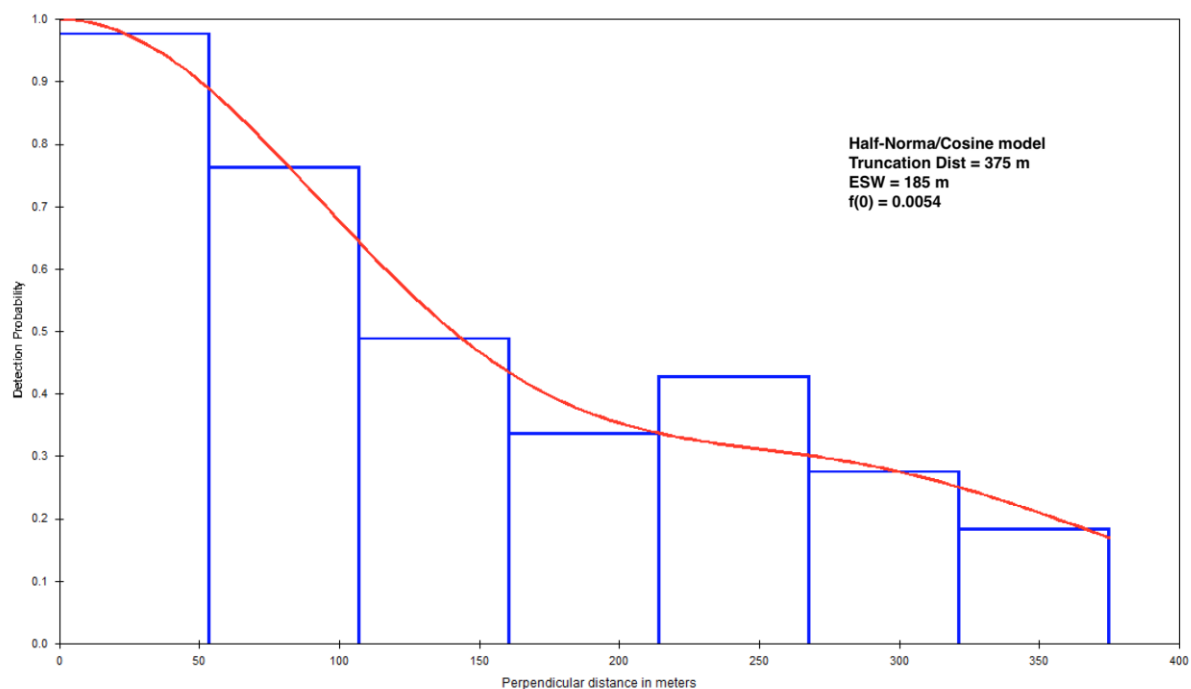



Figure 3: Quantitative Grid Analysis for CWDs

(a) SPSE with Corrected Survey Effort per km² of Year 2025 and Previous Years [SPSE = no. of on-effort dolphin sightings per 100 units of survey effort]

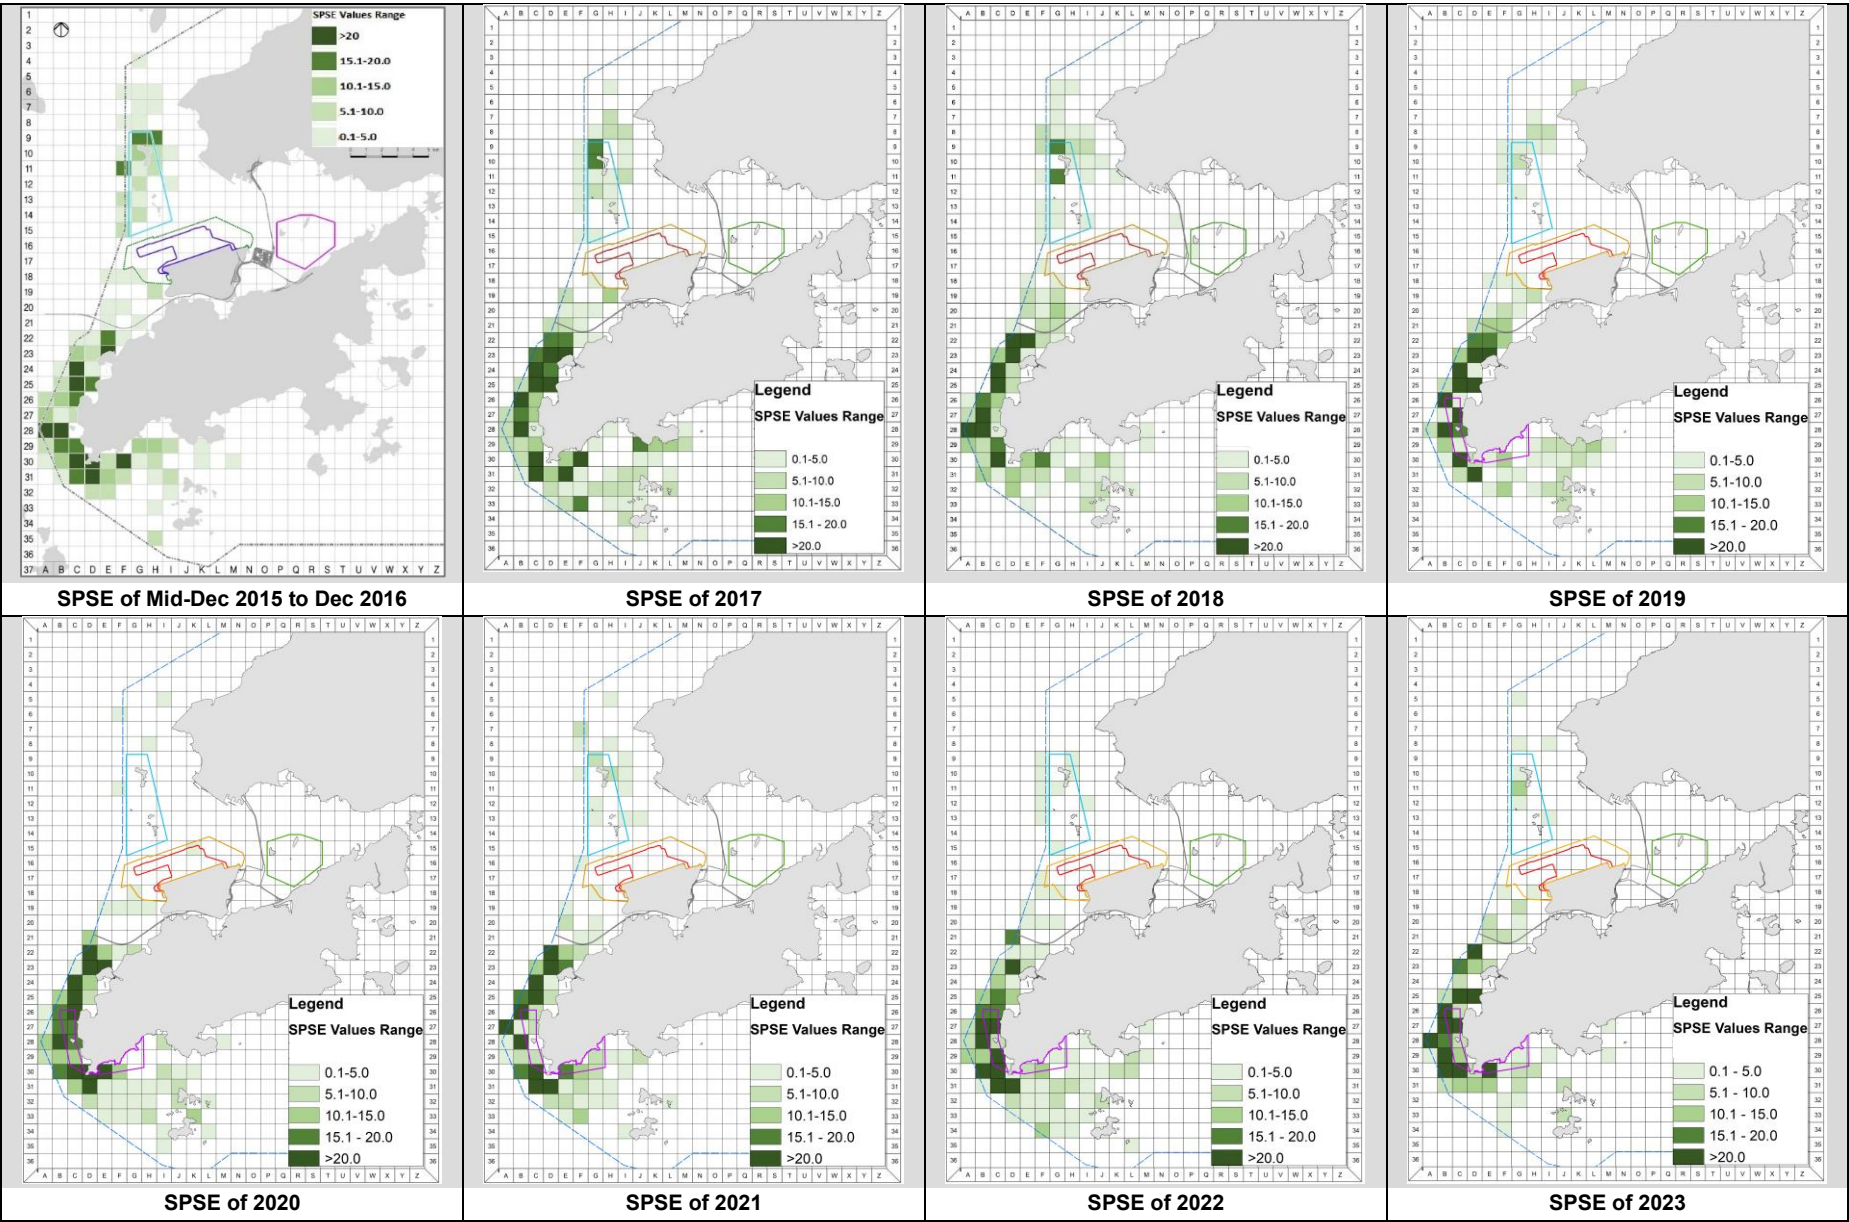

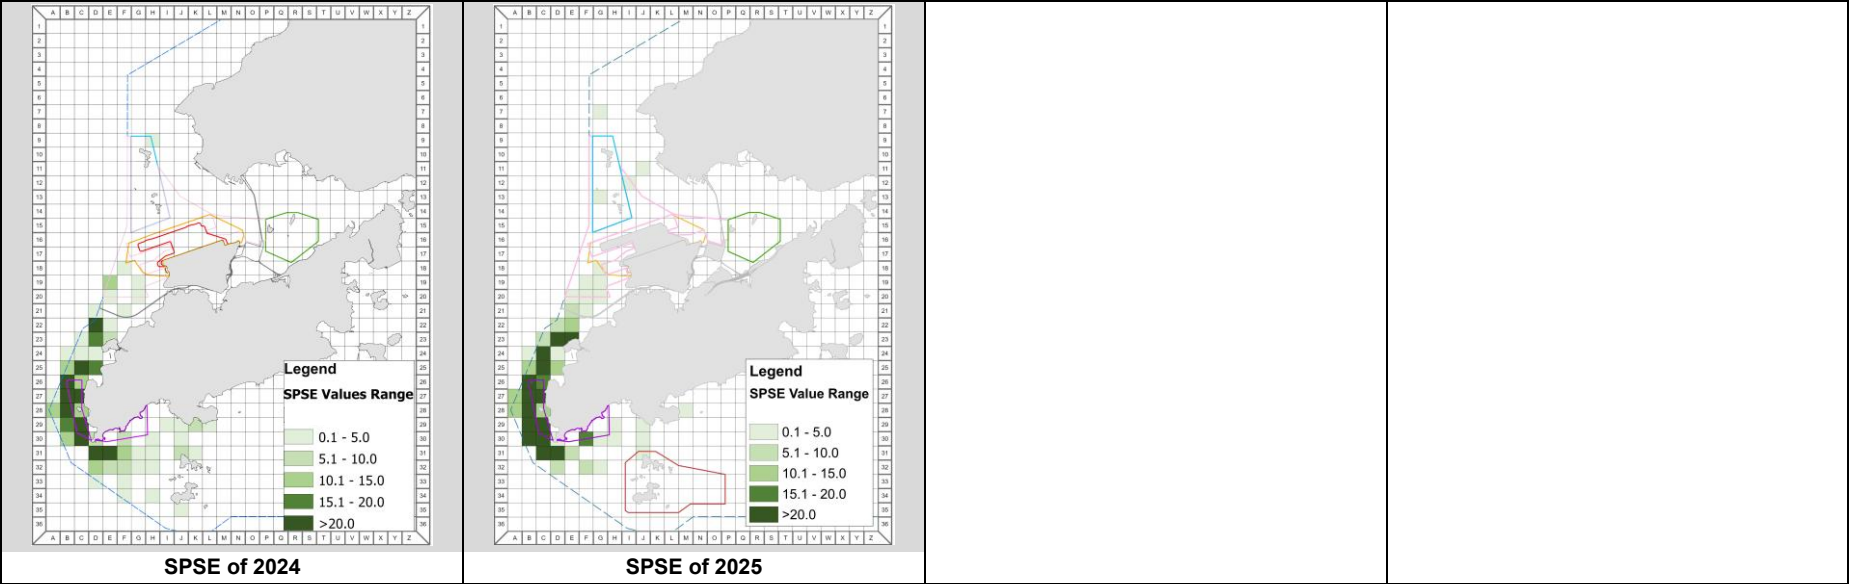

(b) DPSE with Corrected Survey Effort per km² of Year 2025 and Previous Years [DPSE = no. of dolphins per 100 units of survey effort]

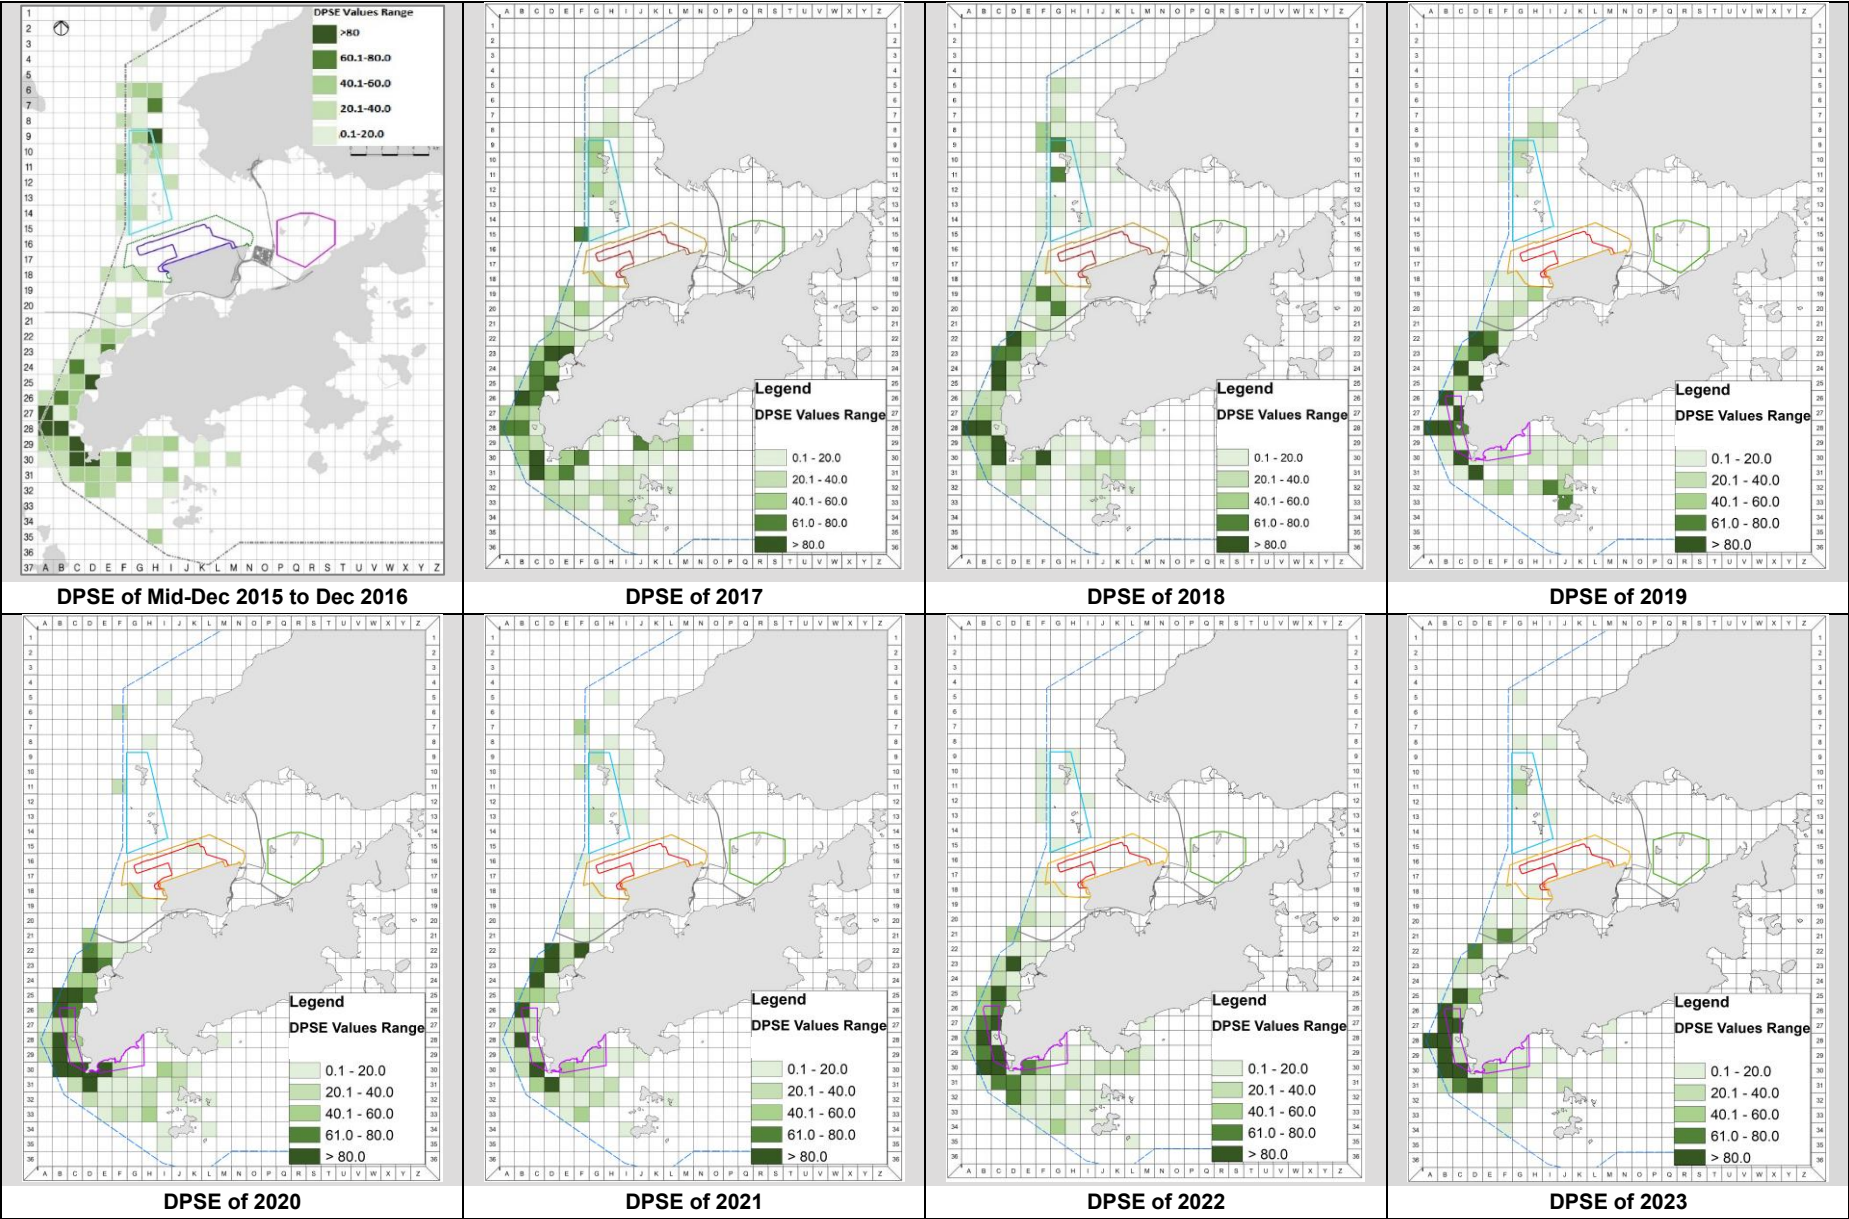

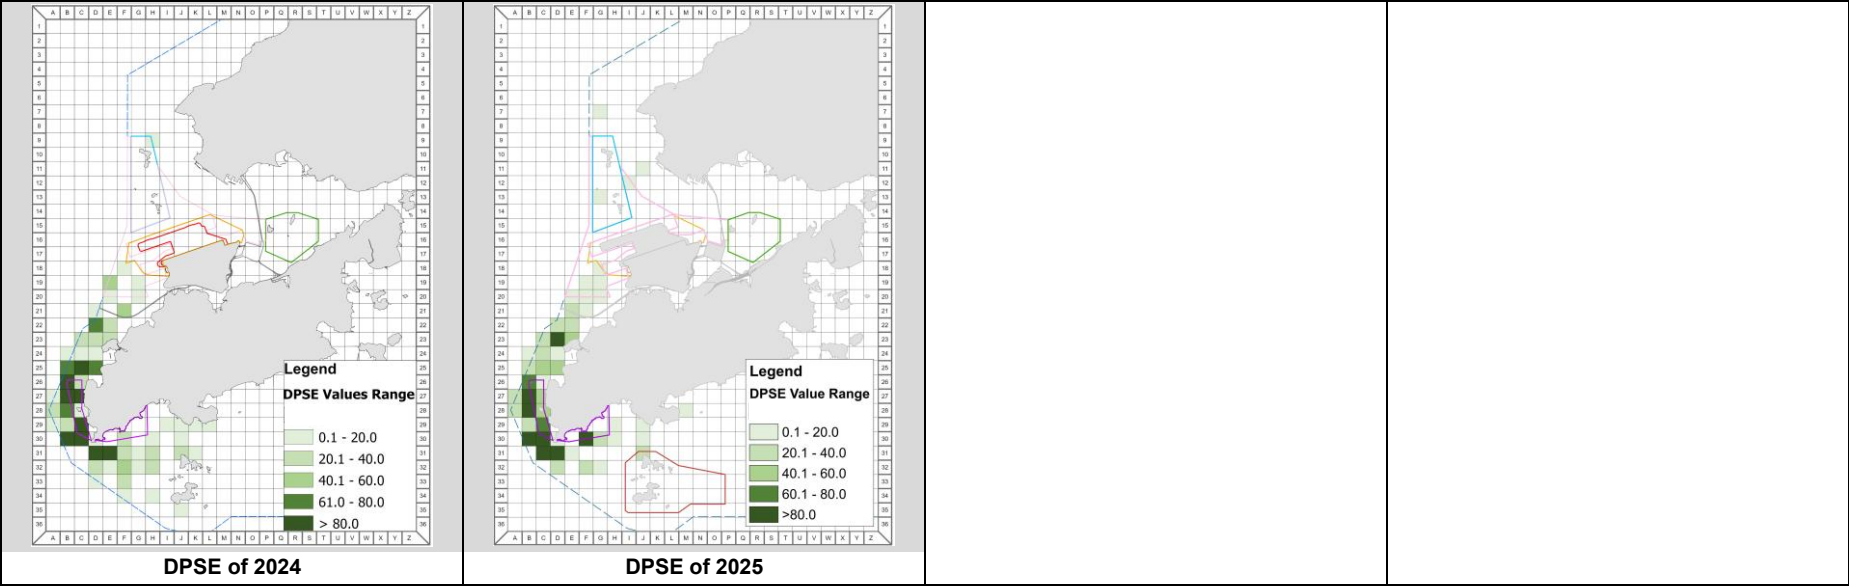


Figure 4: Cumulative SPSE and DPSE of CWDs with Corrected Survey Effort per km² from Dec 2015 to Dec 2025

[SPSE = no. of on-effort dolphin sightings per 100 units of survey effort, DPSE = no. of dolphins per 100 units of survey effort]


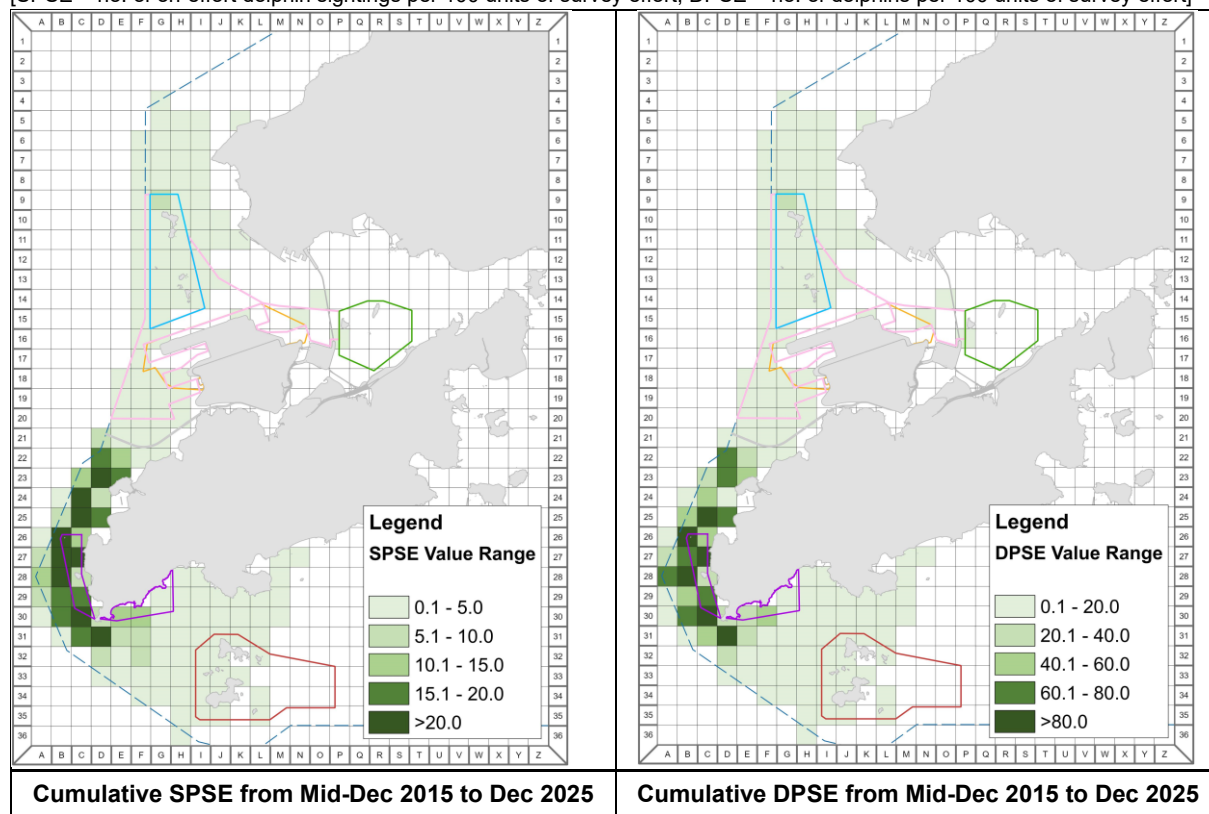


Figure 5: Sightings Distribution of Chinese White Dolphins with Different Group Sizes in 2025
(a) Small Group Size (1 to 2 dolphins)

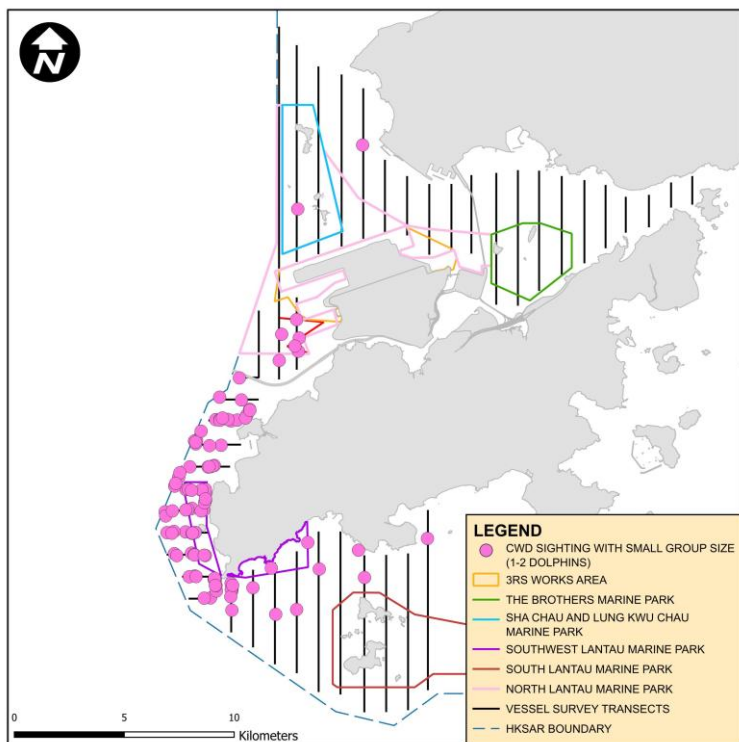

(b) Medium Group Size (3 to 9 dolphins) and Large Group Size (10 or more dolphins)

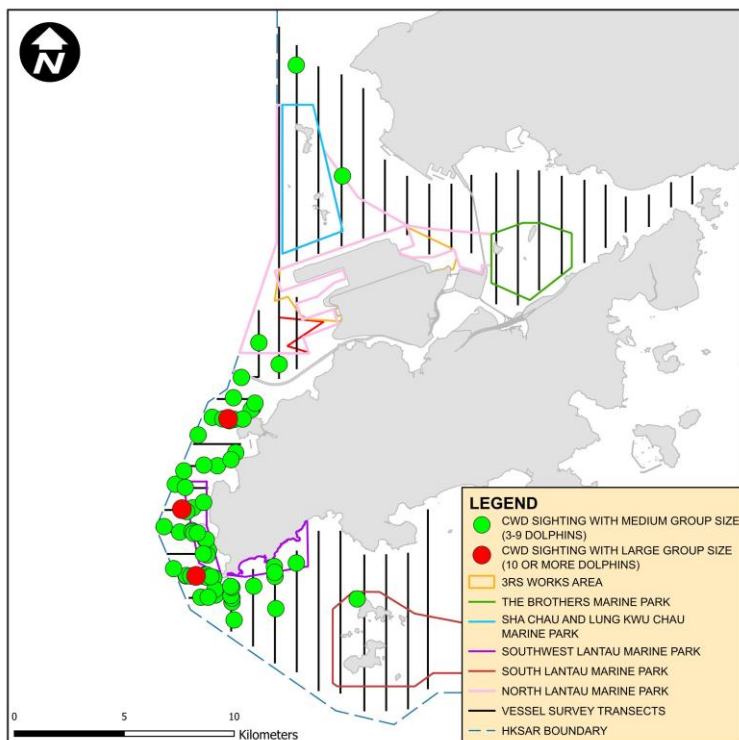


Figure 6: Sighting Locations of CWD Groups Engaged in Different Activities in 2025

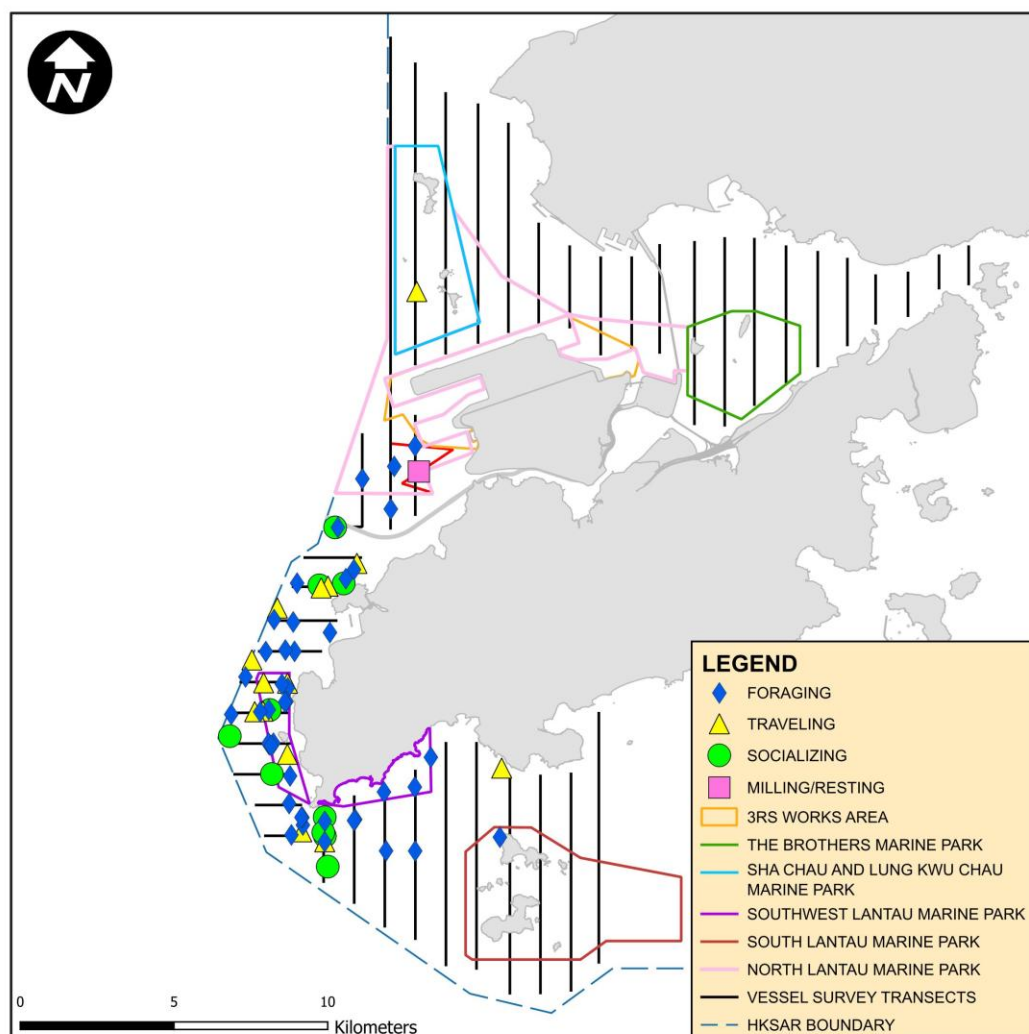


Figure 7: Sighting Locations of CWD Groups in Association with Fishing Boat in 2025

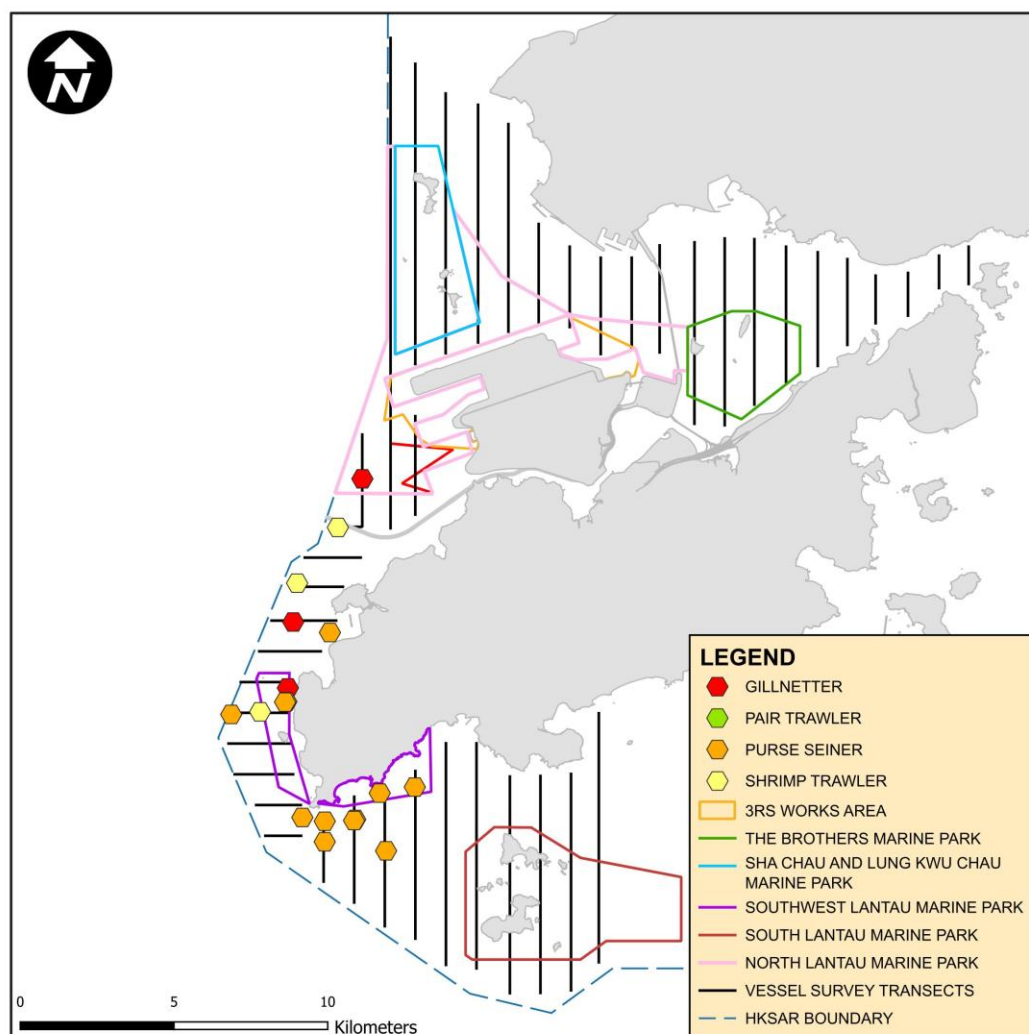


Figure 8: Sighting Locations of Mother-Calf Pairs in 2025



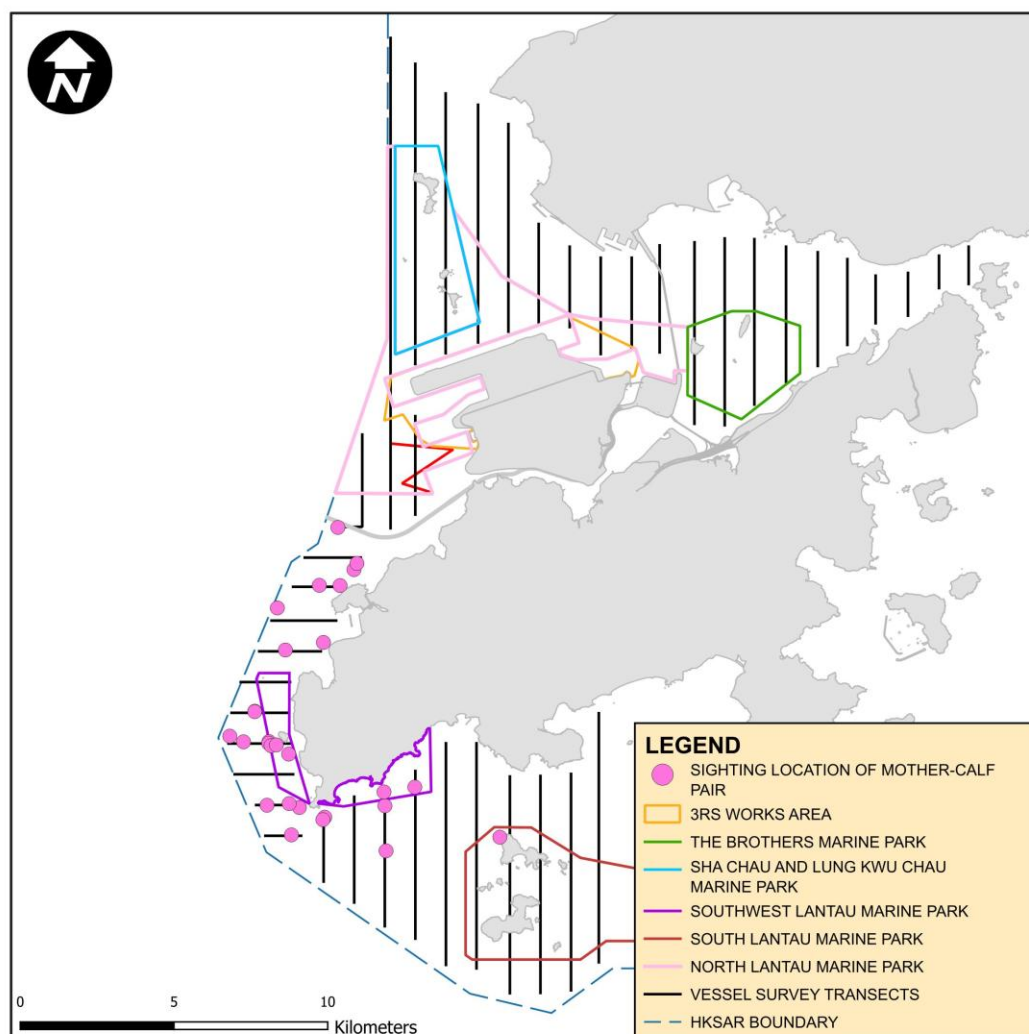


Figure 9: Photo Identification – Re-sighting Locations


(a) SLMM003 – the most frequently re-sighted animal in 2025 and the most frequently sighted animal overall

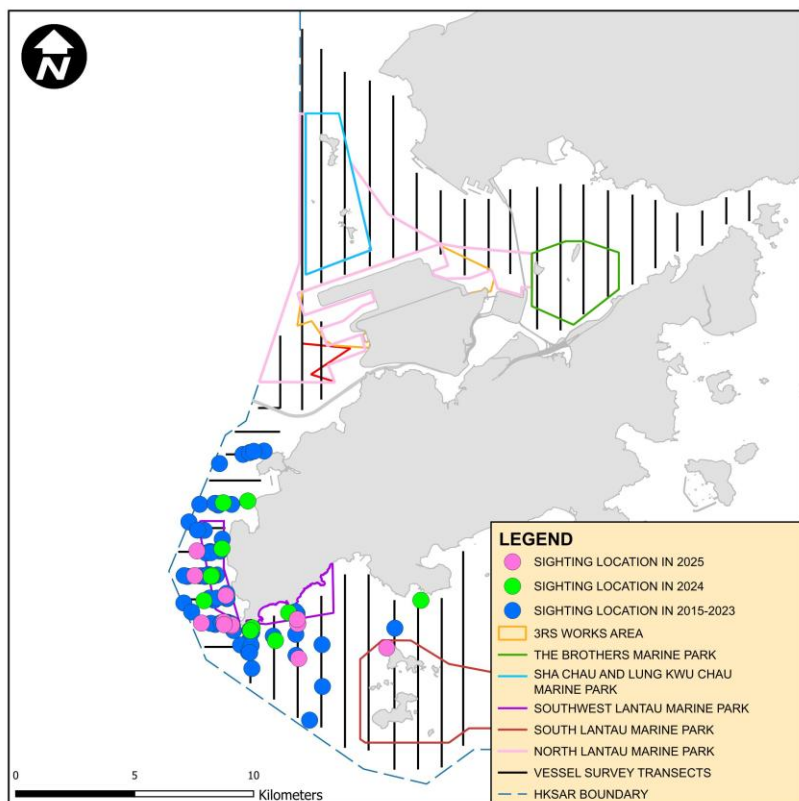

(b) WLMM114 – the 2nd most frequently re-sighted animal in 2025

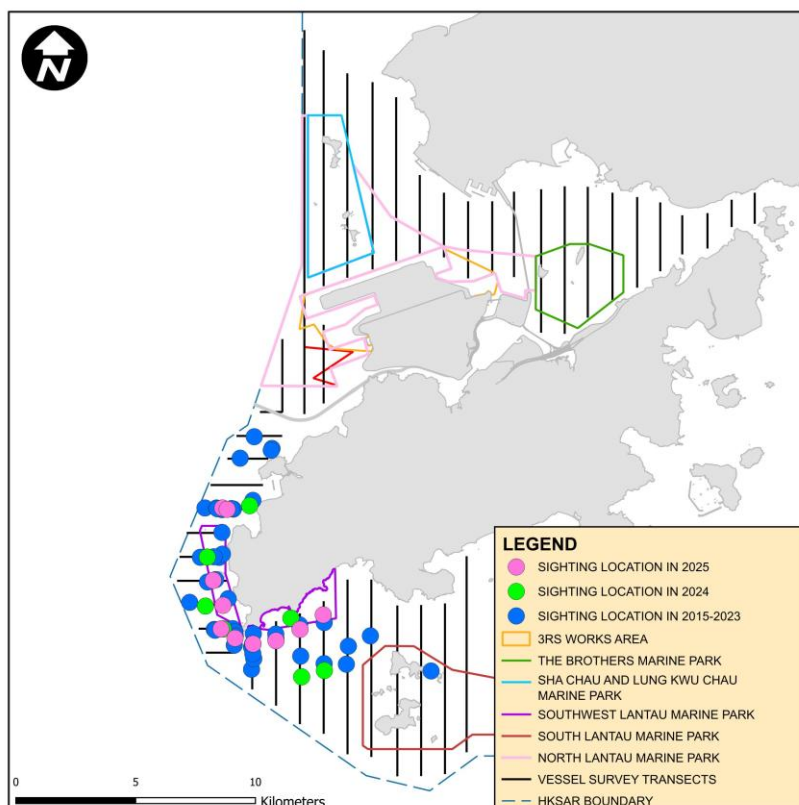

(c) SLMM014 – the 2nd most frequently resighted animal overall

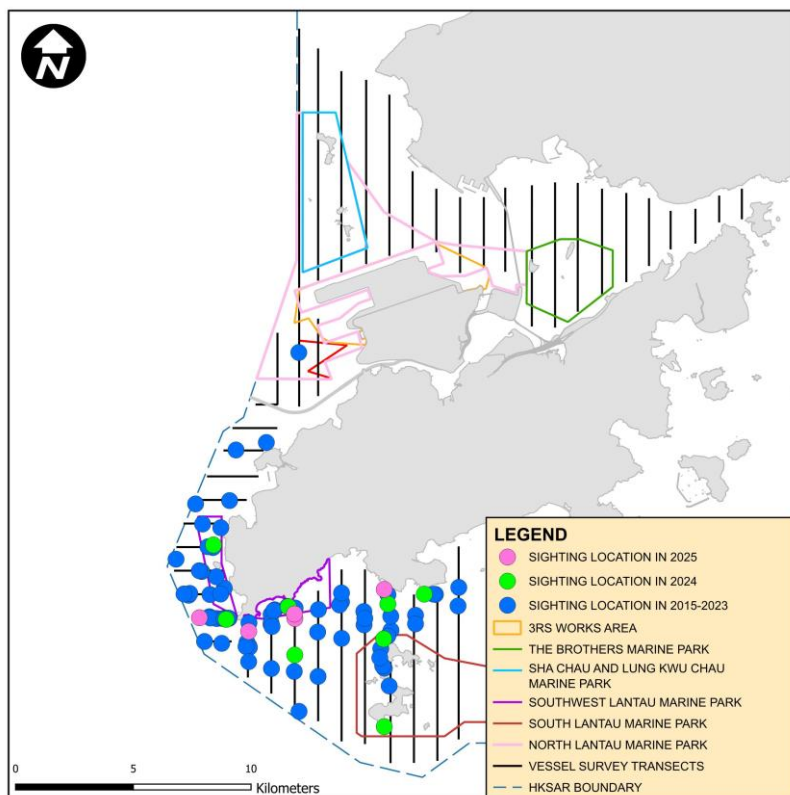

(d) WLMM065 – recorded occurring in all three main survey areas (WL, SWL and NWL) in 2025

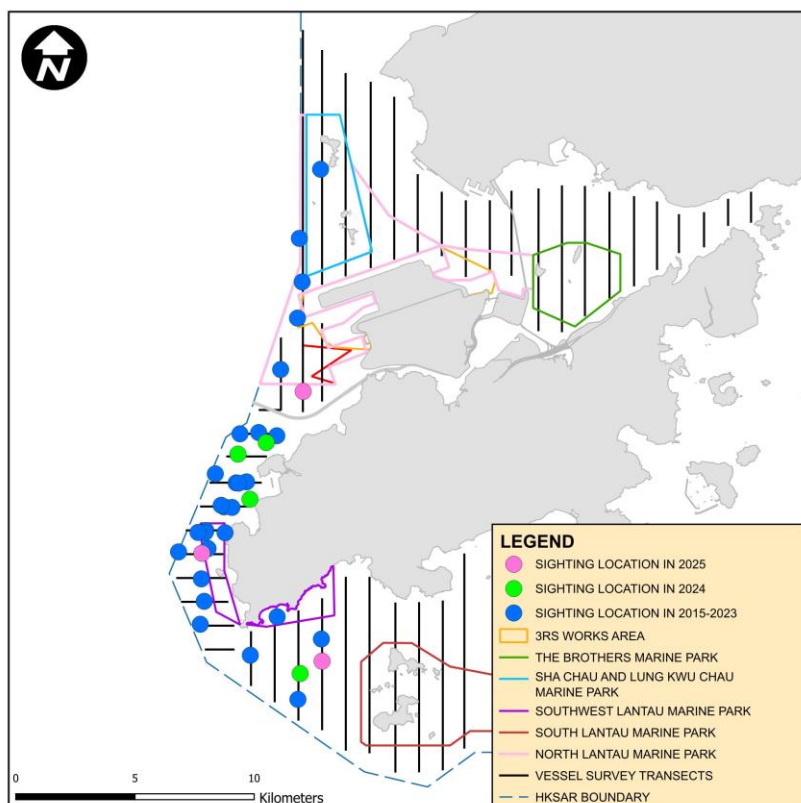


Table 1: CWD Vessel Survey Effort by Survey Areas in 2025

Survey Area	Survey Effort (km)	Survey Effort under Favourable Weather Condition (km)
NEL	1126.4	1126.4
NWL	1800.0	1690.8
AW	115.0	115.0
WL	665.0	655.4
SWL	1646.3	1613.9
Combined	5352.7	5201.5

Table 2: CWD Sightings by Survey Areas in 2025

Survey Area	No. of Sighting (On-effort)	No. of Dolphin (On-effort)	No. of On-effort Sighting under Favourable Weather Condition	No. of On-effort Dolphin under Favourable Weather Condition
NEL	0	0	0	0
NWL	9	20	9	20
AW	2	4	2	4
WL	124	348	124	348
SWL	30	92	30	92
Combined	165	464	165	464

Table 3: CWD Line Transects Parameters and Estimates of Density and Abundance for Western Hong Kong, 2025

Time Period	Stratum	No. of Sight-ings*	Average Group Size	Trackline Detection Prob. - g(0)	Individual Density (no./100km ²)	Abundance	95% CI (Abund.)	%CV
Jan-Dec 2025	AW	1	2.2	1.0	5.06	0	0-1	107.1
Jan-Dec 2025	DB	0	0	1.0	0.00	0	N/A	N/A
Jan-Dec 2025	NEL	0	0	1.0	0.00	0	N/A	N/A
Jan-Dec 2025	NWL	6	2.2	1.0	2.07	1	1-4	52.5
Jan-Dec 2025	SWL	21	2.2	1.0	7.58	5	3-9	31.1
Jan-Dec 2025	WL	85	2.2	1.0	72.18	24	16-36	21.0
Jan-Dec 2025	Pooled^	113	2.2	1.0	17.02	30	21-44	19.4
Jan-Dec 2025	Winter#	28	2.2	1.0	16.72	36	20-65	30.0
Jan-Dec 2025	Spring#	25	2.2	1.0	14.94	32	14-72	41.1
Jan-Dec 2025	Summer #	35	2.2	1.0	17.11	37	21-65	29.2
Jan-Dec 2025	Autumn#	25	2.2	1.0	16.24	35	16-78	41.3

* After truncation

^ Pooled abundance not including Airport West (AW). Note that the pooled estimates do not necessarily add up to the sum of the individual stratum estimates, as these are computed separately.

The seasonal estimates do not include AW.

Table 4: Average Group Sizes of CWDs by Survey Areas in 2025

Survey Area	Average Group Size of CWDs
NEL	0.00
NWL	2.22
AW	2.00
WL	2.81
SWL	3.07
Overall	2.81 ± 2.32

Table 5: Average Group Sizes of CWDs by Seasons in 2025

Solar Season	Average Group Size of CWDs
Spring	2.47
Summer	2.90
Autumn	3.38
Winter	2.50

Table 6: Percentage of CWD Groups recorded as Exhibiting Various Behaviours/Activities, and recorded as having Association with Fishing Boat

Survey Area	Year	Activity				Fishing Boat Association
		Feeding	Travelling	Socialising	Resting/Milling	
AW	2024	100%	-	-	-	-
	2025	-	-	-	50%	-
NEL	2024	-	-	-	-	-
	2025	-	-	-	-	-
NWL	2024	40%	20%	20%	-	-
	2025	33%	11%	-	-	-
WL	2024	21%	11%	17%	4%	5%
	2025	23%	9%	5%	-	9%
SWL	2024	29%	22%	13%	-	11%
	2025	33%	7%	13%	-	23%
Overall	2024	25%	15%	16%	3%	13%
	2025	25%	8%	6%	1%	12%

Table 7: Summary of Photo Identification in 2025

Individual ID	Date of sighting (dd-mmm-yy)	Sighting No.	Area
NLMM012	17-Oct-25	3	WL
NLMM013	20-Jan-25	1	AW
	9-May-25	1	NWL
	27-Aug-25	1	WL
	10-Sep-25	1	NWL
NLMM023	19-Feb-25	3	NWL
	19-Mar-25	1	NWL
	10-Sep-25	1	NWL
NLMM027	19-Feb-25	3	NWL
	10-Sep-25	1	NWL
NLMM028	27-Aug-25	1	WL
NLMM040	30-Sep-25	8	WL
	17-Oct-25	3	WL
NLMM055	20-Mar-25	5	WL
NLMM063	19-Feb-25	3	NWL
	27-Aug-25	5	WL
NLMM065	19-Feb-25	3	NWL
NLMM090	17-Apr-25	2	WL
NLMM093	17-Oct-25	3	WL
NLMM094	19-Mar-25	1	NWL
NLMM095	9-May-25	1	NWL
SLMM003	20-Mar-25	4	WL
		5	WL
		7	WL
	21-Mar-25	5	WL
	17-Apr-25	5	WL
	9-Jun-25	2	SWL
		3	SWL
	15-Jul-25	1	SWL
	27-Aug-25	5	WL
	11-Sep-25	6	WL
	17-Oct-25	6	WL
	11-Dec-25	6	SWL
SLMM007	20-Mar-25	1	WL
		2	WL
	21-Mar-25	2	WL
	16-Jul-25	1	SWL
	16-Oct-25	3	WL
	17-Oct-25	6	WL
	17-Nov-25	2	WL
	15-Dec-25	1	WL
SLMM014	12-Feb-25	8	SWL
	20-Mar-25	5	WL
	9-Jun-25	3	SWL
	20-Aug-25	2	SWL
	11-Dec-25	6	SWL
SLMM022	21-Aug-25	7	WL
	11-Dec-25	7	SWL

Individual ID	Date of sighting (dd-mmm-yy)	Sighting No.	Area
	15-Dec-25	3	WL
		4	WL
SLMM023	18-Feb-25	3	WL
	20-Mar-25	5	WL
	21-Mar-25	1	WL
		5	WL
	17-Apr-25	5	WL
	6-Jun-25	2	WL
	5-Nov-25	3	WL
		4	WL
SLMM025	9-Jun-25	2	SWL
		3	SWL
	15-Jul-25	1	SWL
	11-Dec-25	6	SWL
SLMM027	15-Jul-25	3	SWL
	11-Dec-25	7	SWL
	15-Dec-25	4	WL
SLMM030	5-Feb-25	1	NWL
SLMM031	20-Mar-25	7	WL
		8	WL
	21-Mar-25	4	WL
	15-Apr-25	12	SWL
SLMM034	16-May-25	3	WL
	12-Aug-25	2	SWL
SLMM035	21-Mar-25	4	WL
SLMM049	15-Jul-25	1	SWL
	12-Aug-25	1	SWL
	17-Oct-25	6	WL
SLMM050	16-May-25	4	WL
SLMM052	20-Mar-25	5	WL
	17-Apr-25	5	WL
	9-Jun-25	2	SWL
		3	SWL
	16-Jul-25	1	SWL
	11-Dec-25	7	SWL
	15-Dec-25	3	WL
		4	WL
SLMM055	30-Sep-25	8	WL
SLMM060	14-Jul-25	3	WL
	15-Jul-25	1	SWL
SLMM064	15-Dec-25	1	WL
		3	WL
SLMM071	5-Feb-25	1	NWL
SLMM073	20-Mar-25	1	WL
		2	WL
	21-Mar-25	2	WL
	16-Jul-25	1	SWL
	17-Nov-25	2	WL
	15-Dec-25	1	WL
SLMM074	27-Aug-25	5	WL

Individual ID	Date of sighting (dd-mmm-yy)	Sighting No.	Area
WLMM001	20-Mar-25	5	WL
	14-Jul-25	1	WL
	17-Nov-25	1	WL
WLMM003	27-Aug-25	4	WL
	15-Oct-25	1	SWL
WLMM004	18-Feb-25	6	WL
	21-Aug-25	10	WL
	17-Oct-25	6	WL
	17-Nov-25	1	WL
	15-Dec-25	3	WL
WLMM005	21-Aug-25	7	WL
	17-Oct-25	6	WL
WLMM007	20-Jan-25	6	WL
	17-Oct-25	6	WL
	15-Dec-25	1	WL
		2	WL
		3	WL
		4	WL
WLMM009	15-Dec-25	4	WL
WLMM018	10-Jun-25	4	WL
	15-Jul-25	3	SWL
	21-Aug-25	10	WL
	5-Nov-25	4	WL
WLMM027	27-Aug-25	2	WL
WLMM028	17-Oct-25	6	WL
WLMM029	21-Mar-25	4	WL
	11-Dec-25	6	SWL
WLMM038	17-Jul-25	3	WL
WLMM043	20-Jan-25	1	AW
	19-Feb-25	1	NWL
		2	NWL
	16-May-25	3	WL
WLMM049	20-Mar-25	5	WL
	27-Aug-25	5	WL
	11-Sep-25	6	WL
	30-Sep-25	1	WL
WLMM051	17-Oct-25	3	WL
WLMM052	17-Jul-25	3	WL
WLMM056	17-Jan-25	5	SWL
	20-Jan-25	9	WL
	12-Mar-25	10	SWL
	21-Mar-25	1	WL
		3	WL
	17-Apr-25	3	WL
WLMM058	11-Sep-25	3	WL
	17-Oct-25	2	WL
WLMM063	20-Jan-25	2	WL
	21-Aug-25	10	WL
	17-Oct-25	6	WL
	8-Dec-25	11	SWL

Individual ID	Date of sighting (dd-mmm-yy)	Sighting No.	Area
WLMM065	12-Aug-25	2	SWL
	5-Nov-25	5	WL
	12-Dec-25	1	NWL
WLMM067	16-May-25	4	WL
	16-Jul-25	1	SWL
	17-Oct-25	6	WL
	15-Dec-25	3	WL
WLMM068	16-May-25	4	WL
	11-Sep-25	1	WL
WLMM071	11-Sep-25	3	WL
	17-Oct-25	1	WL
WLMM073	15-Jul-25	3	SWL
	30-Sep-25	5	WL
	17-Oct-25	6	WL
WLMM079	3-Jan-25	1	SWL
	20-Mar-25	1	WL
	21-Mar-25	5	WL
	15-Jul-25	1	SWL
	17-Nov-25	1	WL
	15-Dec-25	1	WL
WLMM080	18-Feb-25	5	WL
	20-Mar-25	6	WL
	8-Dec-25	11	SWL
	11-Dec-25	6	SWL
WLMM087	21-Aug-25	2	WL
WLMM091	30-Sep-25	5	WL
WLMM102	14-Jul-25	1	WL
	17-Oct-25	3	WL
WLMM103	21-Aug-25	2	WL
WLMM109	10-Jun-25	4	WL
	17-Oct-25	6	WL
WLMM111	16-May-25	4	WL
WLMM114	20-Jan-25	9	WL
	3-Mar-25	11	SWL
	9-Jun-25	3	SWL
	16-Jul-25	2	SWL
	12-Aug-25	1	SWL
	27-Aug-25	4	WL
	11-Sep-25	5	WL
	17-Oct-25	4	WL
	5-Nov-25	6	WL
WLMM118	18-Feb-25	5	WL
	15-Jul-25	3	SWL
	21-Aug-25	6	WL
WLMM133	21-Aug-25	5	WL
WLMM141	17-Oct-25	6	WL
WLMM147	20-Mar-25	1	WL
	21-Mar-25	5	WL
	15-Jul-25	1	SWL

Individual ID	Date of sighting (dd-mmm-yy)	Sighting No.	Area
WLMM150	17-Apr-25	3	WL
	9-Jun-25	5	SWL
WLMM151	12-Aug-25	1	SWL
WLMM152	12-Aug-25	1	SWL
	15-Dec-25	2	WL
		4	WL
WLMM155	30-Sep-25	7	WL
WLMM160	17-Nov-25	1	WL
	11-Dec-25	7	SWL
	15-Dec-25	2	WL
WLMM162	16-May-25	4	WL
	11-Sep-25	1	WL
WLMM163	17-Apr-25	5	WL
	15-Dec-25	3	WL
WLMM171	21-Aug-25	8	WL
WLMM180	20-Jan-25	5	WL
WLMM182	17-Oct-25	3	WL
WLMM184	17-Jul-25	1	WL
WLMM190	10-Jun-25	1	WL
	14-Jul-25	1	WL
WLMM192	9-Jun-25	2	SWL
		3	SWL
	16-Jul-25	1	SWL
	11-Dec-25	7	SWL
	15-Dec-25	4	WL
WLMM193	21-Aug-25	1	WL
WLMM195	17-Oct-25	3	WL
WLMM196	17-Oct-25	3	WL
WLMM197	17-Oct-25	3	WL
WLMM202	27-Aug-25	4	WL
WLMM203	17-Jul-25	3	WL
WLMM204	11-Feb-25	1	WL
	17-Jul-25	3	WL
	21-Aug-25	1	WL
WLMM205	11-Feb-25	1	WL
WLMM206	11-Feb-25	2	WL
WLMM207	11-Feb-25	2	WL
WLMM208	11-Feb-25	2	WL
WLMM209	14-Jul-25	1	WL
WLMM210	21-Aug-25	4	WL
	17-Oct-25	3	WL
WLMM211	17-Oct-25	1	WL
WLMM212	17-Oct-25	3	WL
WLMM213	5-Nov-25	5	WL

CWD Small Vessel Line-transect Survey

Survey Effort Data

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
03-Jan-25	SWL	2	0.5	WINTER	32166	3RS ET – OPER	P
03-Jan-25	SWL	3	39.72	WINTER	32166	3RS ET – OPER	P
03-Jan-25	SWL	4	12.65	WINTER	32166	3RS ET – OPER	P
03-Jan-25	SWL	2	1.8	WINTER	32166	3RS ET – OPER	S
03-Jan-25	SWL	3	13.8	WINTER	32166	3RS ET – OPER	S
03-Jan-25	SWL	4	0.93	WINTER	32166	3RS ET – OPER	S
10-Jan-25	DB	2	4	WINTER	32166	3RS ET – OPER	P
10-Jan-25	DB	3	3.2	WINTER	32166	3RS ET – OPER	P
10-Jan-25	DB	2	1.26	WINTER	32166	3RS ET – OPER	S
10-Jan-25	DB	3	3.24	WINTER	32166	3RS ET – OPER	S
10-Jan-25	NEL	2	19.31	WINTER	32166	3RS ET – OPER	P
10-Jan-25	NEL	3	17.6	WINTER	32166	3RS ET – OPER	P
10-Jan-25	NEL	2	6.69	WINTER	32166	3RS ET – OPER	S
10-Jan-25	NEL	3	2.7	WINTER	32166	3RS ET – OPER	S
13-Jan-25	DB	2	6.21	WINTER	32166	3RS ET – OPER	P
13-Jan-25	DB	3	1.73	WINTER	32166	3RS ET – OPER	P
13-Jan-25	DB	2	3.86	WINTER	32166	3RS ET – OPER	S
13-Jan-25	NEL	2	29.78	WINTER	32166	3RS ET – OPER	P
13-Jan-25	NEL	3	6.5	WINTER	32166	3RS ET – OPER	P
13-Jan-25	NEL	2	6.82	WINTER	32166	3RS ET – OPER	S
13-Jan-25	NEL	3	3.4	WINTER	32166	3RS ET – OPER	S
14-Jan-25	NWL	2	47.57	WINTER	32166	3RS ET – OPER	P
14-Jan-25	NWL	3	14.8	WINTER	32166	3RS ET – OPER	P
14-Jan-25	NWL	2	11.33	WINTER	32166	3RS ET – OPER	S
15-Jan-25	AW	3	4.8	WINTER	32166	3RS ET – OPER	P
15-Jan-25	WL	2	1.047	WINTER	32166	3RS ET – OPER	P
15-Jan-25	WL	3	14.109	WINTER	32166	3RS ET – OPER	P
15-Jan-25	WL	4	4.44	WINTER	32166	3RS ET – OPER	P
15-Jan-25	WL	2	0.783	WINTER	32166	3RS ET – OPER	S
15-Jan-25	WL	3	7.312	WINTER	32166	3RS ET – OPER	S
15-Jan-25	WL	4	1.28	WINTER	32166	3RS ET – OPER	S
17-Jan-25	SWL	2	53.296	WINTER	32166	3RS ET – OPER	P
17-Jan-25	SWL	2	15.438	WINTER	32166	3RS ET – OPER	S
20-Jan-25	AW	2	4.63	WINTER	32166	3RS ET – OPER	P
20-Jan-25	WL	2	17.285	WINTER	32166	3RS ET – OPER	P
20-Jan-25	WL	2	10.185	WINTER	32166	3RS ET – OPER	S
21-Jan-25	NWL	2	23.82	WINTER	32166	3RS ET – OPER	P
21-Jan-25	NWL	3	39.38	WINTER	32166	3RS ET – OPER	P
21-Jan-25	NWL	2	3.2	WINTER	32166	3RS ET – OPER	S
21-Jan-25	NWL	3	8.1	WINTER	32166	3RS ET – OPER	S
21-Jan-25	NWL	4	0.8	WINTER	32166	3RS ET – OPER	S
05-Feb-25	NWL	2	28.08	WINTER	32166	3RS ET – OPER	P
05-Feb-25	NWL	3	35.9	WINTER	32166	3RS ET – OPER	P
05-Feb-25	NWL	2	3.4	WINTER	32166	3RS ET – OPER	S
05-Feb-25	NWL	3	7.22	WINTER	32166	3RS ET – OPER	S
10-Feb-25	DB	2	1.42	WINTER	32166	3RS ET – OPER	P
10-Feb-25	DB	3	6.03	WINTER	32166	3RS ET – OPER	P
10-Feb-25	DB	2	2.01	WINTER	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
10-Feb-25	DB	3	2.14	WINTER	32166	3RS ET – OPER	S
10-Feb-25	NEL	2	35.18	WINTER	32166	3RS ET – OPER	P
10-Feb-25	NEL	3	2	WINTER	32166	3RS ET – OPER	P
10-Feb-25	NEL	2	8.72	WINTER	32166	3RS ET – OPER	S
10-Feb-25	NEL	3	1.1	WINTER	32166	3RS ET – OPER	S
11-Feb-25	AW	3	4.84	WINTER	32166	3RS ET – OPER	P
11-Feb-25	WL	2	8.329	WINTER	32166	3RS ET – OPER	P
11-Feb-25	WL	3	9.51	WINTER	32166	3RS ET – OPER	P
11-Feb-25	WL	4	2.068	WINTER	32166	3RS ET – OPER	P
11-Feb-25	WL	2	5.543	WINTER	32166	3RS ET – OPER	S
11-Feb-25	WL	3	1.81	WINTER	32166	3RS ET – OPER	S
11-Feb-25	WL	4	1.782	WINTER	32166	3RS ET – OPER	S
12-Feb-25	SWL	1	53.616	WINTER	32166	3RS ET – OPER	P
12-Feb-25	SWL	1	16.184	WINTER	32166	3RS ET – OPER	S
13-Feb-25	SWL	2	43.931	WINTER	32166	3RS ET – OPER	P
13-Feb-25	SWL	3	10.71	WINTER	32166	3RS ET – OPER	P
13-Feb-25	SWL	2	13.005	WINTER	32166	3RS ET – OPER	S
13-Feb-25	SWL	3	2.63	WINTER	32166	3RS ET – OPER	S
17-Feb-25	DB	2	7.29	WINTER	32166	3RS ET – OPER	P
17-Feb-25	DB	2	4.11	WINTER	32166	3RS ET – OPER	S
17-Feb-25	NEL	1	0.7	WINTER	32166	3RS ET – OPER	P
17-Feb-25	NEL	2	26.71	WINTER	32166	3RS ET – OPER	P
17-Feb-25	NEL	3	8.88	WINTER	32166	3RS ET – OPER	P
17-Feb-25	NEL	1	0.9	WINTER	32166	3RS ET – OPER	S
17-Feb-25	NEL	2	8.38	WINTER	32166	3RS ET – OPER	S
17-Feb-25	NEL	3	2.03	WINTER	32166	3RS ET – OPER	S
18-Feb-25	AW	2	1.65	WINTER	32166	3RS ET – OPER	P
18-Feb-25	AW	3	2.797	WINTER	32166	3RS ET – OPER	P
18-Feb-25	WL	2	14.297	WINTER	32166	3RS ET – OPER	P
18-Feb-25	WL	3	4.24	WINTER	32166	3RS ET – OPER	P
18-Feb-25	WL	2	7.808	WINTER	32166	3RS ET – OPER	S
18-Feb-25	WL	3	2.22	WINTER	32166	3RS ET – OPER	S
19-Feb-25	NWL	2	11.02	WINTER	32166	3RS ET – OPER	P
19-Feb-25	NWL	3	39.59	WINTER	32166	3RS ET – OPER	P
19-Feb-25	NWL	4	10.39	WINTER	32166	3RS ET – OPER	P
19-Feb-25	NWL	2	1.86	WINTER	32166	3RS ET – OPER	S
19-Feb-25	NWL	3	4.96	WINTER	32166	3RS ET – OPER	S
19-Feb-25	NWL	4	2.07	WINTER	32166	3RS ET – OPER	S
03-Mar-25	SWL	1	31.48	SPRING	32166	3RS ET – OPER	P
03-Mar-25	SWL	2	17.866	SPRING	32166	3RS ET – OPER	P
03-Mar-25	SWL	1	14.725	SPRING	32166	3RS ET – OPER	S
03-Mar-25	SWL	2	5.344	SPRING	32166	3RS ET – OPER	S
10-Mar-25	DB	2	7.72	SPRING	32166	3RS ET – OPER	P
10-Mar-25	DB	2	2.78	SPRING	32166	3RS ET – OPER	S
10-Mar-25	DB	3	1.2	SPRING	32166	3RS ET – OPER	S
10-Mar-25	NEL	2	22.93	SPRING	32166	3RS ET – OPER	P
10-Mar-25	NEL	3	13.57	SPRING	32166	3RS ET – OPER	P
10-Mar-25	NEL	2	6.8	SPRING	32166	3RS ET – OPER	S
10-Mar-25	NEL	3	3.4	SPRING	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
12-Mar-25	SWL	1	14.195	SPRING	32166	3RS ET – OPER	P
12-Mar-25	SWL	2	40.604	SPRING	32166	3RS ET – OPER	P
12-Mar-25	SWL	1	2.595	SPRING	32166	3RS ET – OPER	S
12-Mar-25	SWL	2	11.478	SPRING	32166	3RS ET – OPER	S
17-Mar-25	DB	3	7.8	SPRING	32166	3RS ET – OPER	P
17-Mar-25	DB	3	3.9	SPRING	32166	3RS ET – OPER	S
17-Mar-25	NEL	2	14.6	SPRING	32166	3RS ET – OPER	P
17-Mar-25	NEL	3	22.72	SPRING	32166	3RS ET – OPER	P
17-Mar-25	NEL	2	3.2	SPRING	32166	3RS ET – OPER	S
17-Mar-25	NEL	3	6.28	SPRING	32166	3RS ET – OPER	S
18-Mar-25	NWL	2	1.5	SPRING	32166	3RS ET – OPER	P
18-Mar-25	NWL	3	52.5	SPRING	32166	3RS ET – OPER	P
18-Mar-25	NWL	4	9.3	SPRING	32166	3RS ET – OPER	P
18-Mar-25	NWL	2	1	SPRING	32166	3RS ET – OPER	S
18-Mar-25	NWL	3	10.7	SPRING	32166	3RS ET – OPER	S
19-Mar-25	NWL	2	19.41	SPRING	32166	3RS ET – OPER	P
19-Mar-25	NWL	3	42.99	SPRING	32166	3RS ET – OPER	P
19-Mar-25	NWL	2	3.1	SPRING	32166	3RS ET – OPER	S
19-Mar-25	NWL	3	8.5	SPRING	32166	3RS ET – OPER	S
20-Mar-25	AW	2	4.47	SPRING	32166	3RS ET – OPER	P
20-Mar-25	WL	2	12.088	SPRING	32166	3RS ET – OPER	P
20-Mar-25	WL	3	3.764	SPRING	32166	3RS ET – OPER	P
20-Mar-25	WL	2	6.114	SPRING	32166	3RS ET – OPER	S
20-Mar-25	WL	3	1.986	SPRING	32166	3RS ET – OPER	S
21-Mar-25	AW	2	4.69	SPRING	32166	3RS ET – OPER	P
21-Mar-25	WL	2	16.49	SPRING	32166	3RS ET – OPER	P
21-Mar-25	WL	2	9.111	SPRING	32166	3RS ET – OPER	S
03-Apr-25	NWL	2	63.9	SPRING	32166	3RS ET – OPER	P
03-Apr-25	NWL	2	11.5	SPRING	32166	3RS ET – OPER	S
07-Apr-25	DB	1	2.96	SPRING	32166	3RS ET – OPER	P
07-Apr-25	DB	2	4.61	SPRING	32166	3RS ET – OPER	P
07-Apr-25	DB	1	0.94	SPRING	32166	3RS ET – OPER	S
07-Apr-25	DB	2	2.99	SPRING	32166	3RS ET – OPER	S
07-Apr-25	NEL	2	12.23	SPRING	32166	3RS ET – OPER	P
07-Apr-25	NEL	3	24.28	SPRING	32166	3RS ET – OPER	P
07-Apr-25	NEL	2	2.99	SPRING	32166	3RS ET – OPER	S
07-Apr-25	NEL	3	7.6	SPRING	32166	3RS ET – OPER	S
08-Apr-25	SWL	2	33.26	SPRING	32166	3RS ET – OPER	P
08-Apr-25	SWL	3	19.6	SPRING	32166	3RS ET – OPER	P
08-Apr-25	SWL	2	14.43	SPRING	32166	3RS ET – OPER	S
08-Apr-25	SWL	3	2.9	SPRING	32166	3RS ET – OPER	S
09-Apr-25	NWL	2	64	SPRING	32166	3RS ET – OPER	P
09-Apr-25	NWL	2	11.5	SPRING	32166	3RS ET – OPER	S
11-Apr-25	DB	2	7.73	SPRING	32166	3RS ET – OPER	P
11-Apr-25	DB	2	3.77	SPRING	32166	3RS ET – OPER	S
11-Apr-25	NEL	2	23.26	SPRING	32166	3RS ET – OPER	P
11-Apr-25	NEL	3	13.4	SPRING	32166	3RS ET – OPER	P
11-Apr-25	NEL	2	7.24	SPRING	32166	3RS ET – OPER	S
11-Apr-25	NEL	3	3.2	SPRING	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
15-Apr-25	SWL	1	8.034	SPRING	32166	3RS ET – OPER	P
15-Apr-25	SWL	2	44.314	SPRING	32166	3RS ET – OPER	P
15-Apr-25	SWL	1	2.16	SPRING	32166	3RS ET – OPER	S
15-Apr-25	SWL	2	12.777	SPRING	32166	3RS ET – OPER	S
17-Apr-25	AW	1	4.73	SPRING	32166	3RS ET – OPER	P
17-Apr-25	WL	2	8.474	SPRING	32166	3RS ET – OPER	P
17-Apr-25	WL	3	9.107	SPRING	32166	3RS ET – OPER	P
17-Apr-25	WL	2	5.293	SPRING	32166	3RS ET – OPER	S
17-Apr-25	WL	3	4.736	SPRING	32166	3RS ET – OPER	S
22-Apr-25	AW	2	1.93	SPRING	32166	3RS ET – OPER	P
22-Apr-25	AW	3	2.69	SPRING	32166	3RS ET – OPER	P
22-Apr-25	WL	2	0.1	SPRING	32166	3RS ET – OPER	P
22-Apr-25	WL	3	18.8	SPRING	32166	3RS ET – OPER	P
22-Apr-25	WL	3	10.8	SPRING	32166	3RS ET – OPER	S
06-May-25	SWL	2	35.19	SPRING	32166	3RS ET – OPER	P
06-May-25	SWL	3	15.88	SPRING	32166	3RS ET – OPER	P
06-May-25	SWL	2	8	SPRING	32166	3RS ET – OPER	S
06-May-25	SWL	3	10.33	SPRING	32166	3RS ET – OPER	S
09-May-25	NWL	2	43.78	SPRING	32166	3RS ET – OPER	P
09-May-25	NWL	3	10.2	SPRING	32166	3RS ET – OPER	P
09-May-25	NWL	4	2.8	SPRING	32166	3RS ET – OPER	P
09-May-25	NWL	5	6.1	SPRING	32166	3RS ET – OPER	P
09-May-25	NWL	2	6.02	SPRING	32166	3RS ET – OPER	S
09-May-25	NWL	3	2.4	SPRING	32166	3RS ET – OPER	S
09-May-25	NWL	5	3	SPRING	32166	3RS ET – OPER	S
15-May-25	SWL	2	0.73	SPRING	32166	3RS ET – OPER	P
15-May-25	SWL	3	53.88	SPRING	32166	3RS ET – OPER	P
15-May-25	SWL	2	1.7	SPRING	32166	3RS ET – OPER	S
15-May-25	SWL	3	13.99	SPRING	32166	3RS ET – OPER	S
16-May-25	AW	1	4.86	SPRING	32166	3RS ET – OPER	P
16-May-25	WL	2	11.8	SPRING	32166	3RS ET – OPER	P
16-May-25	WL	3	7.157	SPRING	32166	3RS ET – OPER	P
16-May-25	WL	2	4.4	SPRING	32166	3RS ET – OPER	S
16-May-25	WL	3	4.695	SPRING	32166	3RS ET – OPER	S
19-May-25	AW	2	4.6	SPRING	32166	3RS ET – OPER	P
19-May-25	WL	2	16.615	SPRING	32166	3RS ET – OPER	P
19-May-25	WL	3	2.45	SPRING	32166	3RS ET – OPER	P
19-May-25	WL	2	9.255	SPRING	32166	3RS ET – OPER	S
19-May-25	WL	3	1.68	SPRING	32166	3RS ET – OPER	S
20-May-25	NWL	2	2.78	SPRING	32166	3RS ET – OPER	P
20-May-25	NWL	3	60.22	SPRING	32166	3RS ET – OPER	P
20-May-25	NWL	3	12.4	SPRING	32166	3RS ET – OPER	S
21-May-25	DB	3	7.35	SPRING	32166	3RS ET – OPER	P
21-May-25	DB	3	3.95	SPRING	32166	3RS ET – OPER	S
21-May-25	NEL	2	37.07	SPRING	32166	3RS ET – OPER	P
21-May-25	NEL	2	9.73	SPRING	32166	3RS ET – OPER	S
23-May-25	DB	2	0.83	SPRING	32166	3RS ET – OPER	P
23-May-25	DB	3	6.62	SPRING	32166	3RS ET – OPER	P
23-May-25	DB	2	0.97	SPRING	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
23-May-25	DB	3	2.98	SPRING	32166	3RS ET – OPER	S
23-May-25	NEL	2	37.06	SPRING	32166	3RS ET – OPER	P
23-May-25	NEL	2	9.74	SPRING	32166	3RS ET – OPER	S
06-Jun-25	AW	2	4.7	SUMMER	32166	3RS ET – OPER	P
06-Jun-25	WL	2	9.521	SUMMER	32166	3RS ET – OPER	P
06-Jun-25	WL	3	8.581	SUMMER	32166	3RS ET – OPER	P
06-Jun-25	WL	2	4.005	SUMMER	32166	3RS ET – OPER	S
06-Jun-25	WL	3	6.243	SUMMER	32166	3RS ET – OPER	S
09-Jun-25	SWL	2	38.63	SUMMER	32166	3RS ET – OPER	P
09-Jun-25	SWL	3	13.68	SUMMER	32166	3RS ET – OPER	P
09-Jun-25	SWL	2	11.35	SUMMER	32166	3RS ET – OPER	S
09-Jun-25	SWL	3	3.3	SUMMER	32166	3RS ET – OPER	S
10-Jun-25	AW	2	5.06	SUMMER	32166	3RS ET – OPER	P
10-Jun-25	WL	2	18.047	SUMMER	32166	3RS ET – OPER	P
10-Jun-25	WL	2	9.414	SUMMER	32166	3RS ET – OPER	S
10-Jun-25	WL	3	0.34	SUMMER	32166	3RS ET – OPER	S
17-Jun-25	DB	2	4.82	SUMMER	32166	3RS ET – OPER	P
17-Jun-25	DB	3	3.19	SUMMER	32166	3RS ET – OPER	P
17-Jun-25	DB	2	3.89	SUMMER	32166	3RS ET – OPER	S
17-Jun-25	NEL	2	23.67	SUMMER	32166	3RS ET – OPER	P
17-Jun-25	NEL	3	13.87	SUMMER	32166	3RS ET – OPER	P
17-Jun-25	NEL	2	7.96	SUMMER	32166	3RS ET – OPER	S
17-Jun-25	NEL	3	2	SUMMER	32166	3RS ET – OPER	S
18-Jun-25	DB	2	0.6	SUMMER	32166	3RS ET – OPER	P
18-Jun-25	DB	3	7.38	SUMMER	32166	3RS ET – OPER	P
18-Jun-25	DB	2	2.07	SUMMER	32166	3RS ET – OPER	S
18-Jun-25	DB	3	2.05	SUMMER	32166	3RS ET – OPER	S
18-Jun-25	NEL	2	21.33	SUMMER	32166	3RS ET – OPER	P
18-Jun-25	NEL	3	15.88	SUMMER	32166	3RS ET – OPER	P
18-Jun-25	NEL	2	7.8	SUMMER	32166	3RS ET – OPER	S
18-Jun-25	NEL	3	2.49	SUMMER	32166	3RS ET – OPER	S
19-Jun-25	NWL	3	64	SUMMER	32166	3RS ET – OPER	P
19-Jun-25	NWL	3	11.5	SUMMER	32166	3RS ET – OPER	S
20-Jun-25	SWL	2	1.5	SUMMER	32166	3RS ET – OPER	P
20-Jun-25	SWL	3	50.33	SUMMER	32166	3RS ET – OPER	P
20-Jun-25	SWL	2	2.3	SUMMER	32166	3RS ET – OPER	S
20-Jun-25	SWL	3	14.77	SUMMER	32166	3RS ET – OPER	S
23-Jun-25	NWL	3	54.9	SUMMER	32166	3RS ET – OPER	P
23-Jun-25	NWL	4	8.7	SUMMER	32166	3RS ET – OPER	P
23-Jun-25	NWL	3	10.3	SUMMER	32166	3RS ET – OPER	S
23-Jun-25	NWL	4	1.3	SUMMER	32166	3RS ET – OPER	S
07-Jul-25	DB	2	7.57	SUMMER	32166	3RS ET – OPER	P
07-Jul-25	DB	2	3.63	SUMMER	32166	3RS ET – OPER	S
07-Jul-25	NEL	2	36.4	SUMMER	32166	3RS ET – OPER	P
07-Jul-25	NEL	2	10.7	SUMMER	32166	3RS ET – OPER	S
08-Jul-25	DB	2	4.03	SUMMER	32166	3RS ET – OPER	P
08-Jul-25	DB	3	3.52	SUMMER	32166	3RS ET – OPER	P
08-Jul-25	DB	2	2.85	SUMMER	32166	3RS ET – OPER	S
08-Jul-25	DB	3	1.1	SUMMER	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
08-Jul-25	NEL	2	9.5	SUMMER	32166	3RS ET – OPER	P
08-Jul-25	NEL	3	27.13	SUMMER	32166	3RS ET – OPER	P
08-Jul-25	NEL	2	7.87	SUMMER	32166	3RS ET – OPER	S
08-Jul-25	NEL	3	2.5	SUMMER	32166	3RS ET – OPER	S
09-Jul-25	NWL	2	57.9	SUMMER	32166	3RS ET – OPER	P
09-Jul-25	NWL	3	6.3	SUMMER	32166	3RS ET – OPER	P
09-Jul-25	NWL	2	10.2	SUMMER	32166	3RS ET – OPER	S
09-Jul-25	NWL	3	1	SUMMER	32166	3RS ET – OPER	S
14-Jul-25	AW	2	5.04	SUMMER	32166	3RS ET – OPER	P
14-Jul-25	WL	1	3.04	SUMMER	32166	3RS ET – OPER	P
14-Jul-25	WL	2	16.499	SUMMER	32166	3RS ET – OPER	P
14-Jul-25	WL	1	1.69	SUMMER	32166	3RS ET – OPER	S
14-Jul-25	WL	2	6.88	SUMMER	32166	3RS ET – OPER	S
14-Jul-25	WL	3	0.9	SUMMER	32166	3RS ET – OPER	S
15-Jul-25	SWL	2	22.74	SUMMER	32166	3RS ET – OPER	P
15-Jul-25	SWL	3	30.016	SUMMER	32166	3RS ET – OPER	P
15-Jul-25	SWL	2	4.6	SUMMER	32166	3RS ET – OPER	S
15-Jul-25	SWL	3	10.904	SUMMER	32166	3RS ET – OPER	S
16-Jul-25	SWL	2	45.754	SUMMER	32166	3RS ET – OPER	P
16-Jul-25	SWL	3	7.36	SUMMER	32166	3RS ET – OPER	P
16-Jul-25	SWL	2	9.54	SUMMER	32166	3RS ET – OPER	S
16-Jul-25	SWL	3	5.2	SUMMER	32166	3RS ET – OPER	S
17-Jul-25	AW	2	3.01	SUMMER	32166	3RS ET – OPER	P
17-Jul-25	AW	3	1.92	SUMMER	32166	3RS ET – OPER	P
17-Jul-25	WL	2	15.432	SUMMER	32166	3RS ET – OPER	P
17-Jul-25	WL	3	2.71	SUMMER	32166	3RS ET – OPER	P
17-Jul-25	WL	2	6.785	SUMMER	32166	3RS ET – OPER	S
17-Jul-25	WL	3	2.05	SUMMER	32166	3RS ET – OPER	S
18-Jul-25	NWL	1	1.2	SUMMER	32166	3RS ET – OPER	P
18-Jul-25	NWL	2	41.8	SUMMER	32166	3RS ET – OPER	P
18-Jul-25	NWL	3	21.2	SUMMER	32166	3RS ET – OPER	P
18-Jul-25	NWL	1	1.8	SUMMER	32166	3RS ET – OPER	S
18-Jul-25	NWL	2	5.3	SUMMER	32166	3RS ET – OPER	S
18-Jul-25	NWL	3	3.9	SUMMER	32166	3RS ET – OPER	S
01-Aug-25	DB	2	7.3	SUMMER	32166	3RS ET – OPER	P
01-Aug-25	DB	2	4.1	SUMMER	32166	3RS ET – OPER	S
01-Aug-25	NEL	2	28.92	SUMMER	32166	3RS ET – OPER	P
01-Aug-25	NEL	3	8.2	SUMMER	32166	3RS ET – OPER	P
01-Aug-25	NEL	2	9.28	SUMMER	32166	3RS ET – OPER	S
01-Aug-25	NEL	3	0.9	SUMMER	32166	3RS ET – OPER	S
12-Aug-25	SWL	2	49.067	SUMMER	32166	3RS ET – OPER	P
12-Aug-25	SWL	3	2.243	SUMMER	32166	3RS ET – OPER	P
12-Aug-25	SWL	2	14.558	SUMMER	32166	3RS ET – OPER	S
12-Aug-25	SWL	3	1.22	SUMMER	32166	3RS ET – OPER	S
19-Aug-25	DB	2	1.41	SUMMER	32166	3RS ET – OPER	P
19-Aug-25	DB	3	6.05	SUMMER	32166	3RS ET – OPER	P
19-Aug-25	DB	2	0.97	SUMMER	32166	3RS ET – OPER	S
19-Aug-25	DB	3	2.87	SUMMER	32166	3RS ET – OPER	S
19-Aug-25	NEL	2	23.95	SUMMER	32166	3RS ET – OPER	P

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
19-Aug-25	NEL	3	13	SUMMER	32166	3RS ET – OPER	P
19-Aug-25	NEL	2	7.95	SUMMER	32166	3RS ET – OPER	S
19-Aug-25	NEL	3	2.2	SUMMER	32166	3RS ET – OPER	S
20-Aug-25	SWL	2	47.263	SUMMER	32166	3RS ET – OPER	P
20-Aug-25	SWL	3	8.46	SUMMER	32166	3RS ET – OPER	P
20-Aug-25	SWL	2	9.787	SUMMER	32166	3RS ET – OPER	S
20-Aug-25	SWL	3	4.39	SUMMER	32166	3RS ET – OPER	S
21-Aug-25	AW	2	4.88	SUMMER	32166	3RS ET – OPER	P
21-Aug-25	WL	2	4.238	SUMMER	32166	3RS ET – OPER	P
21-Aug-25	WL	3	10.472	SUMMER	32166	3RS ET – OPER	P
21-Aug-25	WL	2	1.517	SUMMER	32166	3RS ET – OPER	S
21-Aug-25	WL	3	8.643	SUMMER	32166	3RS ET – OPER	S
25-Aug-25	NWL	2	20.7	SUMMER	32166	3RS ET – OPER	P
25-Aug-25	NWL	3	42	SUMMER	32166	3RS ET – OPER	P
25-Aug-25	NWL	4	1.4	SUMMER	32166	3RS ET – OPER	P
25-Aug-25	NWL	2	2.7	SUMMER	32166	3RS ET – OPER	S
25-Aug-25	NWL	3	8.3	SUMMER	32166	3RS ET – OPER	S
25-Aug-25	NWL	4	1.1	SUMMER	32166	3RS ET – OPER	S
26-Aug-25	NWL	2	48.1	SUMMER	32166	3RS ET – OPER	P
26-Aug-25	NWL	3	16.1	SUMMER	32166	3RS ET – OPER	P
26-Aug-25	NWL	2	6.6	SUMMER	32166	3RS ET – OPER	S
26-Aug-25	NWL	3	5	SUMMER	32166	3RS ET – OPER	S
27-Aug-25	AW	2	4.76	SUMMER	32166	3RS ET – OPER	P
27-Aug-25	WL	2	18.531	SUMMER	32166	3RS ET – OPER	P
27-Aug-25	WL	2	10.464	SUMMER	32166	3RS ET – OPER	S
09-Sep-25	DB	2	0.4	AUTUMN	32166	3RS ET – OPER	P
09-Sep-25	DB	2	0.96	AUTUMN	32166	3RS ET – OPER	S
09-Sep-25	DB	3	7.41	AUTUMN	32166	3RS ET – OPER	P
09-Sep-25	DB	3	2.83	AUTUMN	32166	3RS ET – OPER	S
09-Sep-25	NEL	2	17.07	AUTUMN	32166	3RS ET – OPER	P
09-Sep-25	NEL	3	20.03	AUTUMN	32166	3RS ET – OPER	P
09-Sep-25	NEL	2	7	AUTUMN	32166	3RS ET – OPER	S
09-Sep-25	NEL	3	3	AUTUMN	32166	3RS ET – OPER	S
10-Sep-25	NWL	2	45.8	AUTUMN	32166	3RS ET – OPER	P
10-Sep-25	NWL	3	18.03	AUTUMN	32166	3RS ET – OPER	P
10-Sep-25	NWL	2	11.07	AUTUMN	32166	3RS ET – OPER	S
10-Sep-25	NWL	3	0.7	AUTUMN	32166	3RS ET – OPER	S
11-Sep-25	AW	2	4.81	AUTUMN	32166	3RS ET – OPER	P
11-Sep-25	WL	1	5.718	AUTUMN	32166	3RS ET – OPER	P
11-Sep-25	WL	1	2.002	AUTUMN	32166	3RS ET – OPER	S
11-Sep-25	WL	2	12.587	AUTUMN	32166	3RS ET – OPER	P
11-Sep-25	WL	3	1.184	AUTUMN	32166	3RS ET – OPER	P
11-Sep-25	WL	2	8.467	AUTUMN	32166	3RS ET – OPER	S
11-Sep-25	WL	3	0.486	AUTUMN	32166	3RS ET – OPER	S
12-Sep-25	SWL	2	30.688	AUTUMN	32166	3RS ET – OPER	P
12-Sep-25	SWL	3	20.88	AUTUMN	32166	3RS ET – OPER	P
12-Sep-25	SWL	2	9.972	AUTUMN	32166	3RS ET – OPER	S
12-Sep-25	SWL	3	5.64	AUTUMN	32166	3RS ET – OPER	S
15-Sep-25	SWL	2	35.164	AUTUMN	32166	3RS ET – OPER	P

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
15-Sep-25	SWL	3	17.458	AUTUMN	32166	3RS ET – OPER	P
15-Sep-25	SWL	2	9.51	AUTUMN	32166	3RS ET – OPER	S
15-Sep-25	SWL	3	7.872	AUTUMN	32166	3RS ET – OPER	S
18-Sep-25	NWL	2	43.85	AUTUMN	32166	3RS ET – OPER	P
18-Sep-25	NWL	3	20.2	AUTUMN	32166	3RS ET – OPER	P
18-Sep-25	NWL	2	7.65	AUTUMN	32166	3RS ET – OPER	S
18-Sep-25	NWL	3	4.1	AUTUMN	32166	3RS ET – OPER	S
22-Sep-25	DB	2	7.88	AUTUMN	32166	3RS ET – OPER	P
22-Sep-25	DB	2	3.72	AUTUMN	32166	3RS ET – OPER	S
22-Sep-25	NEL	2	35.15	AUTUMN	32166	3RS ET – OPER	P
22-Sep-25	NEL	3	1.1	AUTUMN	32166	3RS ET – OPER	P
22-Sep-25	NEL	2	9.25	AUTUMN	32166	3RS ET – OPER	S
30-Sep-25	AW	2	4.83	AUTUMN	32166	3RS ET – OPER	P
30-Sep-25	WL	2	12.653	AUTUMN	32166	3RS ET – OPER	P
30-Sep-25	WL	2	5.905	AUTUMN	32166	3RS ET – OPER	S
08-Oct-25	SWL	2	23.12	AUTUMN	32166	3RS ET – OPER	P
08-Oct-25	SWL	3	26.7	AUTUMN	32166	3RS ET – OPER	P
08-Oct-25	SWL	2	7.28	AUTUMN	32166	3RS ET – OPER	S
08-Oct-25	SWL	3	7.7	AUTUMN	32166	3RS ET – OPER	S
09-Oct-25	NWL	2	41.77	AUTUMN	32166	3RS ET – OPER	P
09-Oct-25	NWL	3	22.8	AUTUMN	32166	3RS ET – OPER	P
09-Oct-25	NWL	2	8.83	AUTUMN	32166	3RS ET – OPER	S
09-Oct-25	NWL	3	2.8	AUTUMN	32166	3RS ET – OPER	S
15-Oct-25	SWL	2	5.7	AUTUMN	32166	3RS ET – OPER	P
15-Oct-25	SWL	3	42.985	AUTUMN	32166	3RS ET – OPER	P
15-Oct-25	SWL	2	3.1	AUTUMN	32166	3RS ET – OPER	S
15-Oct-25	SWL	3	12.66	AUTUMN	32166	3RS ET – OPER	S
16-Oct-25	AW	3	4.96	AUTUMN	32166	3RS ET – OPER	P
16-Oct-25	WL	2	9.59	AUTUMN	32166	3RS ET – OPER	P
16-Oct-25	WL	3	9.532	AUTUMN	32166	3RS ET – OPER	P
16-Oct-25	WL	2	6.85	AUTUMN	32166	3RS ET – OPER	S
16-Oct-25	WL	3	3.195	AUTUMN	32166	3RS ET – OPER	S
17-Oct-25	AW	3	4.97	AUTUMN	32166	3RS ET – OPER	P
17-Oct-25	WL	2	4.839	AUTUMN	32166	3RS ET – OPER	P
17-Oct-25	WL	3	9.816	AUTUMN	32166	3RS ET – OPER	P
17-Oct-25	WL	2	4.206	AUTUMN	32166	3RS ET – OPER	S
17-Oct-25	WL	3	4.612	AUTUMN	32166	3RS ET – OPER	S
24-Oct-25	DB	3	7.96	AUTUMN	32166	3RS ET – OPER	P
24-Oct-25	DB	3	4.04	AUTUMN	32166	3RS ET – OPER	S
24-Oct-25	NEL	2	12.61	AUTUMN	32166	3RS ET – OPER	P
24-Oct-25	NEL	3	24.24	AUTUMN	32166	3RS ET – OPER	P
24-Oct-25	NEL	2	2.84	AUTUMN	32166	3RS ET – OPER	S
24-Oct-25	NEL	3	7.41	AUTUMN	32166	3RS ET – OPER	S
28-Oct-25	DB	3	7.66	AUTUMN	32166	3RS ET – OPER	P
28-Oct-25	DB	3	4.14	AUTUMN	32166	3RS ET – OPER	S
28-Oct-25	NEL	2	34.84	AUTUMN	32166	3RS ET – OPER	P
28-Oct-25	NEL	3	2.46	AUTUMN	32166	3RS ET – OPER	P
28-Oct-25	NEL	2	8.32	AUTUMN	32166	3RS ET – OPER	S
28-Oct-25	NEL	3	1.88	AUTUMN	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
30-Oct-25	NWL	2	28.34	AUTUMN	32166	3RS ET – OPER	P
30-Oct-25	NWL	3	35.46	AUTUMN	32166	3RS ET – OPER	P
30-Oct-25	NWL	2	6.2	AUTUMN	32166	3RS ET – OPER	S
30-Oct-25	NWL	3	5.6	AUTUMN	32166	3RS ET – OPER	S
05-Nov-25	AW	3	4.84	AUTUMN	32166	3RS ET – OPER	P
05-Nov-25	WL	2	1.39	AUTUMN	32166	3RS ET – OPER	P
05-Nov-25	WL	3	16.489	AUTUMN	32166	3RS ET – OPER	P
05-Nov-25	WL	2	0.467	AUTUMN	32166	3RS ET – OPER	S
05-Nov-25	WL	3	9.117	AUTUMN	32166	3RS ET – OPER	S
07-Nov-25	NWL	2	5	AUTUMN	32166	3RS ET – OPER	P
07-Nov-25	NWL	3	47.7	AUTUMN	32166	3RS ET – OPER	P
07-Nov-25	NWL	4	10.7	AUTUMN	32166	3RS ET – OPER	P
07-Nov-25	NWL	2	1.3	AUTUMN	32166	3RS ET – OPER	S
07-Nov-25	NWL	3	5.5	AUTUMN	32166	3RS ET – OPER	S
07-Nov-25	NWL	4	5.5	AUTUMN	32166	3RS ET – OPER	S
14-Nov-25	NWL	2	16.89	AUTUMN	32166	3RS ET – OPER	P
14-Nov-25	NWL	3	46.71	AUTUMN	32166	3RS ET – OPER	P
14-Nov-25	NWL	2	0.6	AUTUMN	32166	3RS ET – OPER	S
14-Nov-25	NWL	3	11	AUTUMN	32166	3RS ET – OPER	S
17-Nov-25	AW	2	4.96	AUTUMN	32166	3RS ET – OPER	P
17-Nov-25	WL	2	12.616	AUTUMN	32166	3RS ET – OPER	P
17-Nov-25	WL	3	7.9	AUTUMN	32166	3RS ET – OPER	P
17-Nov-25	WL	2	4.639	AUTUMN	32166	3RS ET – OPER	S
17-Nov-25	WL	3	5.34	AUTUMN	32166	3RS ET – OPER	S
21-Nov-25	DB	3	6.15	AUTUMN	32166	3RS ET – OPER	P
21-Nov-25	DB	4	1.15	AUTUMN	32166	3RS ET – OPER	P
21-Nov-25	DB	3	4.4	AUTUMN	32166	3RS ET – OPER	S
21-Nov-25	NEL	2	32.314	AUTUMN	32166	3RS ET – OPER	P
21-Nov-25	NEL	3	4.976	AUTUMN	32166	3RS ET – OPER	P
21-Nov-25	NEL	2	9	AUTUMN	32166	3RS ET – OPER	S
21-Nov-25	NEL	3	0.81	AUTUMN	32166	3RS ET – OPER	S
24-Nov-25	SWL	2	34.52	AUTUMN	32166	3RS ET – OPER	P
24-Nov-25	SWL	3	18.4	AUTUMN	32166	3RS ET – OPER	P
24-Nov-25	SWL	4	1.8	AUTUMN	32166	3RS ET – OPER	P
24-Nov-25	SWL	2	11.13	AUTUMN	32166	3RS ET – OPER	S
24-Nov-25	SWL	3	3.2	AUTUMN	32166	3RS ET – OPER	S
24-Nov-25	SWL	4	0.9	AUTUMN	32166	3RS ET – OPER	S
25-Nov-25	SWL	3	38.59	AUTUMN	32166	3RS ET – OPER	P
25-Nov-25	SWL	4	14.9	AUTUMN	32166	3RS ET – OPER	P
25-Nov-25	SWL	3	14.49	AUTUMN	32166	3RS ET – OPER	S
25-Nov-25	SWL	4	1.2	AUTUMN	32166	3RS ET – OPER	S
26-Nov-25	DB	2	0.6	AUTUMN	32166	3RS ET – OPER	P
26-Nov-25	DB	3	5.61	AUTUMN	32166	3RS ET – OPER	P
26-Nov-25	DB	4	1.88	AUTUMN	32166	3RS ET – OPER	P
26-Nov-25	DB	2	2.22	AUTUMN	32166	3RS ET – OPER	S
26-Nov-25	DB	3	1.49	AUTUMN	32166	3RS ET – OPER	S
26-Nov-25	NEL	2	22.39	AUTUMN	32166	3RS ET – OPER	P
26-Nov-25	NEL	3	14.6	AUTUMN	32166	3RS ET – OPER	P
26-Nov-25	NEL	2	5.81	AUTUMN	32166	3RS ET – OPER	S

DATE	AREA	BEAU	KM SEARCHED	SEASON	VESSEL	TYPE	P/S
26-Nov-25	NEL	3	3.9	AUTUMN	32166	3RS ET – OPER	S
04-Dec-25	DB	2	7.550	WINTER	32166	3RS ET – OPER	P
04-Dec-25	DB	2	3.850	WINTER	32166	3RS ET – OPER	S
04-Dec-25	NEL	2	32.772	WINTER	32166	3RS ET – OPER	P
04-Dec-25	NEL	3	4.500	WINTER	32166	3RS ET – OPER	P
04-Dec-25	NEL	2	8.620	WINTER	32166	3RS ET – OPER	S
04-Dec-25	NEL	3	0.928	WINTER	32166	3RS ET – OPER	S
05-Dec-25	NWL	2	61.000	WINTER	32166	3RS ET – OPER	P
05-Dec-25	NWL	3	3.500	WINTER	32166	3RS ET – OPER	P
05-Dec-25	NWL	2	10.300	WINTER	32166	3RS ET – OPER	S
08-Dec-25	SWL	2	49.851	WINTER	32166	3RS ET – OPER	P
08-Dec-25	SWL	3	4.280	WINTER	32166	3RS ET – OPER	P
08-Dec-25	SWL	2	15.010	WINTER	32166	3RS ET – OPER	S
09-Dec-25	DB	3	7.590	WINTER	32166	3RS ET – OPER	P
09-Dec-25	DB	3	4.010	WINTER	32166	3RS ET – OPER	S
09-Dec-25	NEL	1	8.600	WINTER	32166	3RS ET – OPER	P
09-Dec-25	NEL	2	28.240	WINTER	32166	3RS ET – OPER	P
09-Dec-25	NEL	1	1.000	WINTER	32166	3RS ET – OPER	S
09-Dec-25	NEL	2	8.560	WINTER	32166	3RS ET – OPER	S
10-Dec-25	AW	2	4.790	WINTER	32166	3RS ET – OPER	P
10-Dec-25	WL	2	13.450	WINTER	32166	3RS ET – OPER	P
10-Dec-25	WL	3	6.840	WINTER	32166	3RS ET – OPER	P
10-Dec-25	WL	2	7.580	WINTER	32166	3RS ET – OPER	S
10-Dec-25	WL	3	2.830	WINTER	32166	3RS ET – OPER	S
11-Dec-25	SWL	2	52.874	WINTER	32166	3RS ET – OPER	P
11-Dec-25	SWL	2	16.105	WINTER	32166	3RS ET – OPER	S
12-Dec-25	NWL	3	25.390	WINTER	32166	3RS ET – OPER	P
12-Dec-25	NWL	4	38.000	WINTER	32166	3RS ET – OPER	P
12-Dec-25	NWL	3	3.250	WINTER	32166	3RS ET – OPER	S
12-Dec-25	NWL	4	8.060	WINTER	32166	3RS ET – OPER	S
15-Dec-25	AW	2	4.800	WINTER	32166	3RS ET – OPER	P
15-Dec-25	WL	2	6.774	WINTER	32166	3RS ET – OPER	P
15-Dec-25	WL	3	11.682	WINTER	32166	3RS ET – OPER	P
15-Dec-25	WL	2	3.403	WINTER	32166	3RS ET – OPER	S
15-Dec-25	WL	3	7.848	WINTER	32166	3RS ET – OPER	S

CWD Small Vessel Line-transect Survey

Sighting Data

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
03-Jan-25	1	1451	CWD	2	SWL	3	537	ON	3RS ET – OPER	22.192733	113.849709	WINTER	NONE	P
14-Jan-25	1	1032	CWD	3	NWL	2	598	ON	3RS ET – OPER	22.283315	113.870345	WINTER	NONE	P
15-Jan-25	1	1052	CWD	1	WL	3	59	ON	3RS ET – OPER	22.250220	113.844779	WINTER	NONE	P
15-Jan-25	2	1121	CWD	1	WL	3	64	ON	3RS ET – OPER	22.230683	113.837980	WINTER	GILLNETTER	P
15-Jan-25	3	1157	CWD	1	WL	3	1065	ON	3RS ET – OPER	22.205940	113.831778	WINTER	NONE	P
17-Jan-25	1	1229	FP	1	SWL	2	4	ON	3RS ET – OPER	22.190497	113.907741	WINTER	NONE	S
17-Jan-25	2	1235	CWD	1	SWL	2	85	ON	3RS ET – OPER	22.196053	113.908193	WINTER	NONE	P
17-Jan-25	3	1313	FP	2	SWL	2	160	ON	3RS ET – OPER	22.157277	113.897379	WINTER	NONE	P
17-Jan-25	4	1321	FP	1	SWL	2	29	ON	3RS ET – OPER	22.149361	113.892587	WINTER	NONE	S
17-Jan-25	5	1435	CWD	1	SWL	2	29	ON	3RS ET – OPER	22.199487	113.888229	WINTER	NONE	P
17-Jan-25	6	1452	FP	5	SWL	2	264	ON	3RS ET – OPER	22.176366	113.859658	WINTER	NONE	P
17-Jan-25	7	1512	CWD	1	SWL	2	644	ON	3RS ET – OPER	22.193592	113.849312	WINTER	NONE	P
20-Jan-25	1	0935	CWD	2	AW	2	433	ON	3RS ET – OPER	22.294335	113.879179	WINTER	NONE	P
20-Jan-25	2	1023	CWD	4	WL	2	1044	ON	3RS ET – OPER	22.292169	113.861360	WINTER	GILLNETTER	P
20-Jan-25	3	1109	CWD	1	WL	2	718	ON	3RS ET – OPER	22.260745	113.842366	WINTER	NONE	P
20-Jan-25	4	1119	CWD	1	WL	2	244	ON	3RS ET – OPER	22.250059	113.839632	WINTER	GILLNETTER	P
20-Jan-25	5	1142	CWD	1	WL	2	464	ON	3RS ET – OPER	22.241352	113.831001	WINTER	NONE	P
20-Jan-25	6	1155	CWD	2	WL	2	65	ON	3RS ET – OPER	22.232048	113.829246	WINTER	NONE	P
20-Jan-25	7	1213	CWD	2	WL	2	1206	ON	3RS ET – OPER	22.224274	113.831988	WINTER	NONE	P
20-Jan-25	8	1250	CWD	1	WL	2	32	ON	3RS ET – OPER	22.205697	113.824277	WINTER	NONE	P
20-Jan-25	9	1304	CWD	4	WL	2	7	ON	3RS ET – OPER	22.196207	113.836693	WINTER	NONE	P
05-Feb-25	1	1053	CWD	2	NWL	3	1510	ON	3RS ET – OPER	22.301830	113.877975	WINTER	NONE	P
11-Feb-25	1	1025	CWD	2	WL	2	500	ON	3RS ET – OPER	22.262800	113.856200	WINTER	NONE	S
11-Feb-25	2	1034	CWD	3	WL	2	25	ON	3RS ET – OPER	22.260629	113.850578	WINTER	NONE	P
11-Feb-25	3	1105	CWD	1	WL	2	52	ON	3RS ET – OPER	22.252210	113.833890	WINTER	NONE	S
11-Feb-25	4	1132	CWD	1	WL	2	564	ON	3RS ET – OPER	22.233410	113.824343	WINTER	NONE	S
11-Feb-25	5	1143	CWD	1	WL	2	1047	ON	3RS ET – OPER	22.227700	113.837958	WINTER	NONE	S
11-Feb-25	6	1210	CWD	1	WL	3	135	ON	3RS ET – OPER	22.214623	113.829190	WINTER	NONE	P
12-Feb-25	1	1038	FP	1	SWL	2	358	ON	3RS ET – OPER	22.190764	113.936842	WINTER	NONE	P
12-Feb-25	2	1106	FP	2	SWL	2	43	ON	3RS ET – OPER	22.150776	113.927012	WINTER	NONE	P
12-Feb-25	3	1117	FP	2	SWL	2	116	ON	3RS ET – OPER	22.171095	113.927790	WINTER	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
12-Feb-25	4	1202	FP	1	SWL	2	244	ON	3RS ET – OPER	22.149072	113.918469	WINTER	NONE	P
12-Feb-25	5	1255	FP	1	SWL	2	242	ON	3RS ET – OPER	22.196298	113.898119	WINTER	NONE	P
12-Feb-25	6	1315	FP	1	SWL	2	187	ON	3RS ET – OPER	22.155293	113.897126	WINTER	NONE	P
12-Feb-25	7	1420	FP	1	SWL	2	125	ON	3RS ET – OPER	22.159605	113.871398	WINTER	NONE	S
12-Feb-25	8	1510	CWD	2	SWL	2	306	ON	3RS ET – OPER	22.191088	113.849718	WINTER	NONE	P
13-Feb-25	1	1154	FP	1	SWL	2	50	ON	3RS ET – OPER	22.148269	113.917100	WINTER	NONE	P
13-Feb-25	2	1157	FP	1	SWL	2	261	ON	3RS ET – OPER	22.145245	113.917177	WINTER	NONE	P
18-Feb-25	1	0938	CWD	2	AW	2	323	ON	3RS ET – OPER	22.288875	113.878802	WINTER	NONE	P
18-Feb-25	2	1035	CWD	1	WL	2	31	ON	3RS ET – OPER	22.264985	113.857344	WINTER	NONE	S
18-Feb-25	3	1044	CWD	1	WL	2	238	ON	3RS ET – OPER	22.260249	113.849154	WINTER	NONE	P
18-Feb-25	4	1052	CWD	1	WL	2	120	ON	3RS ET – OPER	22.260691	113.844222	WINTER	NONE	P
18-Feb-25	5	1130	CWD	5	WL	2	333	ON	3RS ET – OPER	22.233903	113.824617	WINTER	NONE	S
18-Feb-25	6	1154	CWD	2	WL	2	159	ON	3RS ET – OPER	22.223541	113.837104	WINTER	NONE	S
18-Feb-25	7	1211	CWD	1	WL	2	72	ON	3RS ET – OPER	22.223253	113.836042	WINTER	NONE	S
19-Feb-25	1	1022	CWD	1	NWL	3	288	ON	3RS ET – OPER	22.295838	113.871414	WINTER	NONE	P
19-Feb-25	2	1054	CWD	1	NWL	2	279	ON	3RS ET – OPER	22.290978	113.877263	WINTER	NONE	P
19-Feb-25	3	1150	CWD	4	NWL	2	426	ON	3RS ET – OPER	22.406281	113.877617	WINTER	NONE	P
03-Mar-25	1	1055	FP	3	SWL	1	1	ON	3RS ET – OPER	22.183540	113.936279	SPRING	NONE	P
03-Mar-25	2	1116	FP	3	SWL	1	34	ON	3RS ET – OPER	22.145204	113.930076	SPRING	NONE	S
03-Mar-25	3	1119	FP	2	SWL	1	81	ON	3RS ET – OPER	22.147736	113.927216	SPRING	NONE	P
03-Mar-25	4	1129	FP	4	SWL	1	126	ON	3RS ET – OPER	22.165093	113.927504	SPRING	NONE	P
03-Mar-25	5	1155	FP	6	SWL	1	139	ON	3RS ET – OPER	22.196880	113.917735	SPRING	NONE	P
03-Mar-25	6	1215	FP	1	SWL	1	313	ON	3RS ET – OPER	22.158444	113.917714	SPRING	NONE	P
03-Mar-25	7	1219	FP	1	SWL	1	28	ON	3RS ET – OPER	22.152765	113.917749	SPRING	NONE	P
03-Mar-25	8	1234	FP	6	SWL	1	397	ON	3RS ET – OPER	22.149244	113.908270	SPRING	NONE	P
03-Mar-25	9	1243	FP	3	SWL	1	12	ON	3RS ET – OPER	22.161935	113.898550	SPRING	NONE	S
03-Mar-25	10	1337	FP	1	SWL	2	155	ON	3RS ET – OPER	22.156443	113.897168	SPRING	NONE	P
03-Mar-25	11	1529	CWD	1	SWL	2	118	ON	3RS ET – OPER	22.190556	113.849708	SPRING	NONE	P
03-Mar-25	12	1537	CWD	1	SWL	2	111	ON	3RS ET – OPER	22.191077	113.849387	SPRING	NONE	P
12-Mar-25	1	1110	FP	2	SWL	1	234	ON	3RS ET – OPER	22.159833	113.927398	SPRING	NONE	P
12-Mar-25	2	1119	FP	1	SWL	1	52	ON	3RS ET – OPER	22.176666	113.928266	SPRING	NONE	P
12-Mar-25	3	1125	FP	1	SWL	1	424	ON	3RS ET – OPER	22.187550	113.927616	SPRING	NONE	P
12-Mar-25	4	1141	FP	6	SWL	2	296	ON	3RS ET – OPER	22.198940	113.917615	SPRING	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
12-Mar-25	5	1214	FP	2	SWL	2	12	ON	3RS ET – OPER	22.147290	113.907780	SPRING	NONE	P
12-Mar-25	6	1222	FP	2	SWL	2	206	ON	3RS ET – OPER	22.196773	113.899798	SPRING	NONE	S
12-Mar-25	7	1317	FP	8	SWL	2	26	ON	3RS ET – OPER	22.156301	113.897570	SPRING	NONE	P
12-Mar-25	8	1323	FP	6	SWL	2	175	ON	3RS ET – OPER	22.148902	113.893346	SPRING	NONE	S
12-Mar-25	9	1336	FP	1	SWL	2	95	ON	3RS ET – OPER	22.165877	113.887683	SPRING	NONE	P
12-Mar-25	10	1359	CWD	1	SWL	1	26	ON	3RS ET – OPER	22.210401	113.883150	SPRING	NONE	S
12-Mar-25	11	1422	FP	1	SWL	1	29	ON	3RS ET – OPER	22.191921	113.878339	SPRING	NONE	P
12-Mar-25	12	1427	FP	1	SWL	2	61	ON	3RS ET – OPER	22.183075	113.878552	SPRING	NONE	P
12-Mar-25	13	1451	FP	3	SWL	2	14	ON	3RS ET – OPER	22.178749	113.868783	SPRING	NONE	P
12-Mar-25	14	1456	FP	1	SWL	2	17	ON	3RS ET – OPER	22.184075	113.868467	SPRING	NONE	P
12-Mar-25	15	1459	FP	2	SWL	2	21	ON	3RS ET – OPER	22.187993	113.868395	SPRING	NONE	P
19-Mar-25	1	1107	CWD	2	NWL	3	313	ON	3RS ET – OPER	22.347225	113.878416	SPRING	NONE	P
20-Mar-25	1	1115	CWD	6	WL	2	836	ON	3RS ET – OPER	22.223815	113.827586	SPRING	NONE	P
20-Mar-25	2	1134	CWD	2	WL	2	262	ON	3RS ET – OPER	22.214824	113.824038	SPRING	NONE	P
20-Mar-25	3	1142	CWD	3	WL	2	390	ON	3RS ET – OPER	22.214912	113.832078	SPRING	NONE	P
20-Mar-25	4	1154	CWD	3	WL	2	513	ON	3RS ET – OPER	22.206800	113.839286	SPRING	NONE	S
20-Mar-25	5	1210	CWD	8	WL	2	107	ON	3RS ET – OPER	22.196280	113.829415	SPRING	NONE	P
20-Mar-25	6	1223	CWD	2	WL	2	238	ON	3RS ET – OPER	22.196546	113.833261	SPRING	NONE	P
20-Mar-25	7	1233	CWD	2	WL	2	311	ON	3RS ET – OPER	22.195202	113.841788	SPRING	NONE	P
20-Mar-25	8	1245	CWD	1	WL	3	20	ON	3RS ET – OPER	22.195065	113.842396	SPRING	NONE	S
20-Mar-25	9	1256	CWD	3	WL	2	36	ON	3RS ET – OPER	22.187513	113.835985	SPRING	NONE	P
21-Mar-25	1	1043	CWD	3	WL	2	514	ON	3RS ET – OPER	22.246990	113.851225	SPRING	PURSE SEINER	S
21-Mar-25	2	1101	CWD	2	WL	2	155	ON	3RS ET – OPER	22.237011	113.826072	SPRING	NONE	S
21-Mar-25	3	1120	CWD	1	WL	2	185	ON	3RS ET – OPER	22.232192	113.830334	SPRING	NONE	P
21-Mar-25	4	1131	CWD	4	WL	2	92	ON	3RS ET – OPER	22.224202	113.832300	SPRING	NONE	P
21-Mar-25	5	1153	CWD	4	WL	2	381	ON	3RS ET – OPER	22.214271	113.826562	SPRING	NONE	P
08-Apr-25	1	1036	FP	2	SWL	1	71	ON	3RS ET – OPER	22.193704	113.936244	SPRING	NONE	P
08-Apr-25	2	1044	FP	2	SWL	2	350	ON	3RS ET – OPER	22.179386	113.935990	SPRING	NONE	P
08-Apr-25	3	1111	FP	1	SWL	2	75	ON	3RS ET – OPER	22.164292	113.927572	SPRING	NONE	P
15-Apr-25	1	1153	FP	2	SWL	2	70	ON	3RS ET – OPER	22.152396	113.917341	SPRING	NONE	P
15-Apr-25	2	1210	FP	2	SWL	2	161	ON	3RS ET – OPER	22.154933	113.902673	SPRING	NONE	S
15-Apr-25	3	1258	FP	1	SWL	2	126	ON	3RS ET – OPER	22.177199	113.897364	SPRING	NONE	P
15-Apr-25	4	1302	FP	1	SWL	2	228	ON	3RS ET – OPER	22.170798	113.897120	SPRING	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
15-Apr-25	5	1308	FP	1	SWL	2	256	ON	3RS ET – OPER	22.158703	113.896943	SPRING	NONE	P
15-Apr-25	6	1310	FP	4	SWL	2	41	ON	3RS ET – OPER	22.154309	113.897139	SPRING	NONE	P
15-Apr-25	7	1324	FP	1	SWL	2	83	ON	3RS ET – OPER	22.164758	113.888631	SPRING	NONE	P
15-Apr-25	8	1337	FP	2	SWL	2	178	ON	3RS ET – OPER	22.192654	113.888238	SPRING	NONE	P
15-Apr-25	9	1349	FP	2	SWL	2	119	ON	3RS ET – OPER	22.212648	113.885390	SPRING	NONE	S
15-Apr-25	10	1412	FP	2	SWL	1	50	ON	3RS ET – OPER	22.164074	113.878414	SPRING	NONE	P
15-Apr-25	11	1415	FP	3	SWL	1	14	ON	3RS ET – OPER	22.157950	113.878676	SPRING	NONE	P
15-Apr-25	12	1431	CWD	1	SWL	1	149	ON	3RS ET – OPER	22.180883	113.869018	SPRING	NONE	P
17-Apr-25	1	1022	CWD	1	WL	2	476	ON	3RS ET – OPER	22.260575	113.851938	SPRING	NONE	P
17-Apr-25	2	1038	CWD	2	WL	2	39	ON	3RS ET – OPER	22.251964	113.833047	SPRING	NONE	S
17-Apr-25	3	1105	CWD	3	WL	2	139	ON	3RS ET – OPER	22.241576	113.843157	SPRING	NONE	P
17-Apr-25	4	1130	CWD	1	WL	3	95	ON	3RS ET – OPER	22.232096	113.837869	SPRING	NONE	P
17-Apr-25	5	1221	CWD	7	WL	3	174	ON	3RS ET – OPER	22.195575	113.841702	SPRING	NONE	P
22-Apr-25	1	1145	CWD	1	WL	2	240	ON	3RS ET – OPER	22.187556	113.840253	SPRING	NONE	P
09-May-25	1	1333	CWD	2	NWL	2	30	ON	3RS ET – OPER	22.373559	113.907000	SPRING	NONE	P
16-May-25	1	1115	CWD	2	WL	2	856	ON	3RS ET – OPER	22.238898	113.826616	SPRING	NONE	S
16-May-25	2	1142	CWD	1	WL	3	702	ON	3RS ET – OPER	22.223854	113.830159	SPRING	NONE	P
16-May-25	3	1155	CWD	2	WL	3	19	ON	3RS ET – OPER	22.222867	113.820136	SPRING	PURSE SEINER	S
16-May-25	4	1218	CWD	5	WL	3	112	ON	3RS ET – OPER	22.216483	113.819700	SPRING	NONE	S
16-May-25	5	1245	CWD	2	WL	3	137	ON	3RS ET – OPER	22.214317	113.820992	SPRING	NONE	P
16-May-25	6	1315	CWD	2	WL	3	76	ON	3RS ET – OPER	22.196230	113.830844	SPRING	NONE	P
16-May-25	7	1335	CWD	2	WL	3	300	ON	3RS ET – OPER	22.187450	113.837444	SPRING	NONE	P
19-May-25	1	1109	CWD	1	WL	2	477	ON	3RS ET – OPER	22.226658	113.837521	SPRING	PURSE SEINER	S
06-Jun-25	1	1021	CWD	4	WL	2	233	ON	3RS ET – OPER	22.260083	113.848416	SUMMER	NONE	P
06-Jun-25	2	1052	CWD	1	WL	3	1	ON	3RS ET – OPER	22.241436	113.840074	SUMMER	NONE	P
06-Jun-25	3	1112	CWD	1	WL	3	243	ON	3RS ET – OPER	22.231800	113.836097	SUMMER	NONE	P
06-Jun-25	4	1138	CWD	1	WL	3	432	ON	3RS ET – OPER	22.221155	113.820377	SUMMER	NONE	S
06-Jun-25	5	1213	CWD	2	WL	3	61	ON	3RS ET – OPER	22.190420	113.842823	SUMMER	NONE	S
09-Jun-25	1	1054	FP	1	SWL	2	160	ON	3RS ET – OPER	22.167172	113.928430	SUMMER	NONE	P
09-Jun-25	2	1213	CWD	5	SWL	2	85	ON	3RS ET – OPER	22.186956	113.904974	SUMMER	NONE	S
09-Jun-25	3	1420	CWD	6	SWL	2	39	ON	3RS ET – OPER	22.196116	113.868687	SUMMER	NONE	P
09-Jun-25	4	1454	CWD	1	SWL	2	49	ON	3RS ET – OPER	22.182531	113.849686	SUMMER	NONE	P
09-Jun-25	5	1506	CWD	2	SWL	3	28	ON	3RS ET – OPER	22.188082	113.849182	SUMMER	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
10-Jun-25	1	1114	CWD	4	WL	2	975	ON	3RS ET – OPER	22.222725	113.829681	SUMMER	NONE	P
10-Jun-25	2	1142	CWD	1	WL	2	29	ON	3RS ET – OPER	22.214030	113.832107	SUMMER	NONE	P
10-Jun-25	3	1216	CWD	1	WL	3	472	ON	3RS ET – OPER	22.192645	113.842653	SUMMER	PURSE SEINER	S
10-Jun-25	4	1236	CWD	3	WL	2	168	ON	3RS ET – OPER	22.188445	113.842476	SUMMER	NONE	S
14-Jul-25	1	1026	CWD	4	WL	1	7	ON	3RS ET – OPER	22.265490	113.858778	SUMMER	NONE	S
14-Jul-25	2	1145	CWD	3	WL	2	721	ON	3RS ET – OPER	22.211214	113.837882	SUMMER	NONE	S
14-Jul-25	3	1206	CWD	1	WL	2	16	ON	3RS ET – OPER	22.204954	113.837920	SUMMER	NONE	P
15-Jul-25	1	1418	CWD	8	SWL	3	282	ON	3RS ET – OPER	22.182891	113.869078	SUMMER	PURSE SEINER	P
15-Jul-25	2	1452	CWD	3	SWL	2	450	ON	3RS ET – OPER	22.192101	113.859323	SUMMER	PURSE SEINER	P
15-Jul-25	3	1529	CWD	4	SWL	2	836	ON	3RS ET – OPER	22.185511	113.849721	SUMMER	PURSE SEINER	P
16-Jul-25	1	1429	CWD	7	SWL	2	586	ON	3RS ET – OPER	22.200188	113.868391	SUMMER	NONE	P
16-Jul-25	2	1458	CWD	1	SWL	2	487	ON	3RS ET – OPER	22.191771	113.858955	SUMMER	PURSE SEINER	P
16-Jul-25	3	1546	CWD	2	SWL	3	82	ON	3RS ET – OPER	22.192766	113.850012	SUMMER	NONE	P
17-Jul-25	1	1024	CWD	4	WL	2	240	ON	3RS ET – OPER	22.264715	113.858046	SUMMER	NONE	S
17-Jul-25	2	1043	CWD	1	WL	2	762	ON	3RS ET – OPER	22.256001	113.835945	SUMMER	NONE	S
17-Jul-25	3	1058	CWD	6	WL	2	838	ON	3RS ET – OPER	22.244070	113.849171	SUMMER	NONE	S
17-Jul-25	4	1124	CWD	1	WL	2	406	ON	3RS ET – OPER	22.241927	113.841787	SUMMER	NONE	P
17-Jul-25	5	1143	CWD	1	WL	2	80	ON	3RS ET – OPER	22.231947	113.836298	SUMMER	NONE	P
17-Jul-25	6	1216	CWD	2	WL	2	457	ON	3RS ET – OPER	22.205393	113.833011	SUMMER	NONE	P
12-Aug-25	1	1352	CWD	7	SWL	2	689	ON	3RS ET – OPER	22.201644	113.878102	SUMMER	PURSE SEINER	P
12-Aug-25	2	1414	CWD	2	SWL	3	45	ON	3RS ET – OPER	22.182867	113.878263	SUMMER	NONE	P
12-Aug-25	3	1454	CWD	2	SWL	2	202	ON	3RS ET – OPER	22.199843	113.867045	SUMMER	PURSE SEINER	P
12-Aug-25	4	1523	CWD	4	SWL	2	135	ON	3RS ET – OPER	22.178222	113.850690	SUMMER	NONE	P
12-Aug-25	5	1538	CWD	5	SWL	2	188	ON	3RS ET – OPER	22.187196	113.849762	SUMMER	NONE	P
20-Aug-25	1	1022	CWD	1	SWL	2	24	ON	3RS ET – OPER	22.212132	113.935946	SUMMER	NONE	P
20-Aug-25	2	1233	CWD	1	SWL	2	3	ON	3RS ET – OPER	22.207270	113.905501	SUMMER	NONE	S
21-Aug-25	1	1019	CWD	2	WL	2	86	ON	3RS ET – OPER	22.277880	113.852780	SUMMER	NONE	S
21-Aug-25	2	1029	CWD	2	WL	2	110	ON	3RS ET – OPER	22.269950	113.844080	SUMMER	NONE	S
21-Aug-25	3	1046	CWD	2	WL	2	84	ON	3RS ET – OPER	22.268840	113.853710	SUMMER	NONE	P
21-Aug-25	4	1057	CWD	4	WL	2	630	ON	3RS ET – OPER	22.260800	113.854390	SUMMER	NONE	S
21-Aug-25	5	1115	CWD	1	WL	3	81	ON	3RS ET – OPER	22.250760	113.833600	SUMMER	NONE	S
21-Aug-25	6	1212	CWD	1	WL	3	111	ON	3RS ET – OPER	22.214080	113.823140	SUMMER	NONE	P
21-Aug-25	7	1221	CWD	5	WL	3	101	ON	3RS ET – OPER	22.214450	113.831980	SUMMER	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
21-Aug-25	8	1232	CWD	4	WL	3	98	ON	3RS ET – OPER	22.204830	113.838750	SUMMER	NONE	S
21-Aug-25	9	1244	CWD	1	WL	3	83	ON	3RS ET – OPER	22.205160	113.833090	SUMMER	NONE	P
21-Aug-25	10	1304	CWD	4	WL	3	463	ON	3RS ET – OPER	22.196760	113.837760	SUMMER	NONE	P
27-Aug-25	1	1059	CWD	2	WL	2	24	ON	3RS ET – OPER	22.261416	113.855545	SUMMER	NONE	S
27-Aug-25	2	1107	CWD	1	WL	2	161	ON	3RS ET – OPER	22.260827	113.847760	SUMMER	NONE	P
27-Aug-25	3	1113	CWD	5	WL	2	196	ON	3RS ET – OPER	22.261478	113.840830	SUMMER	SHRIMP TRAWLER	P
27-Aug-25	4	1153	CWD	4	WL	2	82	ON	3RS ET – OPER	22.241820	113.837182	SUMMER	NONE	S
27-Aug-25	5	1245	CWD	5	WL	2	206	ON	3RS ET – OPER	22.196709	113.838474	SUMMER	NONE	P
10-Sep-25	1	1237	CWD	4	NWL	3	6	ON	3RS ET – OPER	22.360756	113.898129	AUTUMN	NONE	P
11-Sep-25	1	1017	CWD	4	WL	1	1390	ON	3RS ET – OPER	22.277875	113.853656	AUTUMN	SHRIMP TRAWLER	P
11-Sep-25	2	1101	CWD	4	WL	2	341	ON	3RS ET – OPER	22.260810	113.845503	AUTUMN	NONE	P
11-Sep-25	3	1121	CWD	3	WL	2	134	ON	3RS ET – OPER	22.254176	113.834611	AUTUMN	NONE	S
11-Sep-25	4	1143	CWD	1	WL	2	92	ON	3RS ET – OPER	22.241733	113.841163	AUTUMN	NONE	P
11-Sep-25	5	1225	CWD	1	WL	2	223	ON	3RS ET – OPER	22.214454	113.833467	AUTUMN	NONE	P
11-Sep-25	6	1256	CWD	3	WL	2	102	ON	3RS ET – OPER	22.195709	113.838746	AUTUMN	NONE	P
12-Sep-25	1	1042	FP	3	SWL	2	30	ON	3RS ET – OPER	22.168309	113.935910	AUTUMN	NONE	P
12-Sep-25	2	1115	FP	1	SWL	2	61	ON	3RS ET – OPER	22.184967	113.926777	AUTUMN	NONE	P
12-Sep-25	3	1126	FP	1	SWL	2	261	ON	3RS ET – OPER	22.205188	113.926493	AUTUMN	NONE	P
15-Sep-25	1	1035	FP	1	SWL	2	54	ON	3RS ET – OPER	22.191325	113.936273	AUTUMN	NONE	P
15-Sep-25	2	1037	FP	1	SWL	2	391	ON	3RS ET – OPER	22.188163	113.936064	AUTUMN	NONE	P
15-Sep-25	3	1040	FP	1	SWL	2	153	ON	3RS ET – OPER	22.186218	113.936006	AUTUMN	NONE	P
15-Sep-25	4	1046	FP	2	SWL	2	112	ON	3RS ET – OPER	22.176503	113.935833	AUTUMN	NONE	P
15-Sep-25	5	1056	FP	1	SWL	2	161	ON	3RS ET – OPER	22.155609	113.936013	AUTUMN	NONE	P
15-Sep-25	6	1100	FP	2	SWL	2	142	ON	3RS ET – OPER	22.150124	113.935230	AUTUMN	NONE	P
15-Sep-25	7	1104	FP	4	SWL	2	103	ON	3RS ET – OPER	22.146130	113.931312	AUTUMN	NONE	S
15-Sep-25	8	1111	FP	1	SWL	2	463	ON	3RS ET – OPER	22.154265	113.927476	AUTUMN	NONE	P
15-Sep-25	9	1213	FP	1	SWL	3	114	ON	3RS ET – OPER	22.147837	113.908383	AUTUMN	NONE	P
30-Sep-25	1	1008	CWD	4	WL	2	7	ON	3RS ET – OPER	22.190698	113.842251	AUTUMN	NONE	S
30-Sep-25	2	1030	CWD	4	WL	2	614	ON	3RS ET – OPER	22.196423	113.829584	AUTUMN	NONE	P
30-Sep-25	3	1036	CWD	3	WL	2	530	ON	3RS ET – OPER	22.199226	113.823932	AUTUMN	NONE	S
30-Sep-25	4	1106	CWD	1	WL	2	122	ON	3RS ET – OPER	22.214147	113.832246	AUTUMN	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
30-Sep-25	5	1123	CWD	2	WL	2	2	ON	3RS ET – OPER	22.223250	113.823370	AUTUMN	NONE	P
30-Sep-25	6	1141	CWD	1	WL	2	707	ON	3RS ET – OPER	22.228185	113.837941	AUTUMN	NONE	S
30-Sep-25	7	1149	CWD	3	WL	2	306	ON	3RS ET – OPER	22.232617	113.828997	AUTUMN	NONE	P
30-Sep-25	8	1159	CWD	5	WL	2	259	ON	3RS ET – OPER	22.239431	113.828354	AUTUMN	NONE	S
30-Sep-25	9	1242	CWD	2	WL	2	267	ON	3RS ET – OPER	22.260501	113.844242	AUTUMN	NONE	P
30-Sep-25	10	1308	CWD	3	WL	2	102	ON	3RS ET – OPER	22.269521	113.850198	AUTUMN	NONE	P
15-Oct-25	1	1005	CWD	4	SWL	3	508	ON	3RS ET – OPER	22.188268	113.849284	AUTUMN	NONE	P
16-Oct-25	1	1014	CWD	2	WL	3	N/A	OFF	3RS ET – OPER	22.195612	113.842022	AUTUMN	NONE	S
16-Oct-25	2	1026	CWD	1	WL	3	4	ON	3RS ET – OPER	22.196315	113.833867	AUTUMN	NONE	P
16-Oct-25	3	1042	CWD	4	WL	3	513	ON	3RS ET – OPER	22.196208	113.831485	AUTUMN	NONE	P
16-Oct-25	4	1057	CWD	2	WL	3	50	ON	3RS ET – OPER	22.204878	113.825332	AUTUMN	NONE	S
17-Oct-25	1	1024	CWD	3	WL	3	9	ON	3RS ET – OPER	22.267319	113.859696	AUTUMN	NONE	S
17-Oct-25	2	1042	CWD	1	WL	2	181	ON	3RS ET – OPER	22.264621	113.857456	AUTUMN	NONE	S
17-Oct-25	3	1051	CWD	15	WL	2	465	ON	3RS ET – OPER	22.260853	113.847848	AUTUMN	NONE	P
17-Oct-25	4	1126	CWD	2	WL	3	753	ON	3RS ET – OPER	22.241289	113.839078	AUTUMN	NONE	P
17-Oct-25	5	1144	CWD	1	WL	2	572	ON	3RS ET – OPER	22.234546	113.824753	AUTUMN	NONE	S
17-Oct-25	6	1159	CWD	14	WL	3	246	ON	3RS ET – OPER	22.223695	113.827545	AUTUMN	NONE	P
05-Nov-25	1	1032	CWD	2	WL	3	178	ON	3RS ET – OPER	22.261427	113.845349	AUTUMN	NONE	P
05-Nov-25	2	1042	CWD	1	WL	3	357	ON	3RS ET – OPER	22.251499	113.833502	AUTUMN	NONE	S
05-Nov-25	3	1110	CWD	2	WL	3	115	ON	3RS ET – OPER	22.231720	113.831750	AUTUMN	NONE	P
05-Nov-25	4	1127	CWD	4	WL	2	926	ON	3RS ET – OPER	22.226519	113.837109	AUTUMN	PURSE SEINER	S
05-Nov-25	5	1156	CWD	2	WL	3	238	ON	3RS ET – OPER	22.223652	113.829262	AUTUMN	SHRIMP TRAWLER	P
05-Nov-25	6	1220	CWD	1	WL	3	51	ON	3RS ET – OPER	22.205100	113.837452	AUTUMN	NONE	P
05-Nov-25	7	1239	CWD	1	WL	3	14	ON	3RS ET – OPER	22.192672	113.842363	AUTUMN	NONE	S
17-Nov-25	1	1126	CWD	8	WL	2	257	ON	3RS ET – OPER	22.213713	113.832734	AUTUMN	NONE	P
17-Nov-25	2	1205	CWD	5	WL	2	702	ON	3RS ET – OPER	22.211253	113.838298	AUTUMN	NONE	P
17-Nov-25	3	1240	CWD	4	WL	2	585	ON	3RS ET – OPER	22.195983	113.840415	AUTUMN	NONE	P
14-Nov-25	1	1048	FP	2	SWL	2	229	ON	3RS ET – OPER	22.168197	113.936129	AUTUMN	NONE	P
25-Nov-25	1	1207	FP	1	SWL	3	78	ON	3RS ET – OPER	22.154362	113.904509	AUTUMN	NONE	S
25-Nov-25	2	1303	FP	1	SWL	3	97	ON	3RS ET – OPER	22.174191	113.896831	AUTUMN	NONE	P
08-Dec-25	1	1045	FP	1	SWL	2	94	ON	3RS ET – OPER	22.180691	113.936298	WINTER	NONE	P
08-Dec-25	2	1115	FP	2	SWL	3	30	ON	3RS ET – OPER	22.168863	113.927351	WINTER	NONE	P

DATE	STG #	TIME	CWD/FP	GP SZ	AREA	BEAU	PSD	EFFORT	TYPE	DEC LAT	DEC LON	SEASON	BOAT ASSOC.	P/S
08-Dec-25	3	1206	FP	2	SWL	2	48	ON	3RS ET – OPER	22.141244	113.913392	WINTER	NONE	S
08-Dec-25	4	1210	FP	3	SWL	2	103	ON	3RS ET – OPER	22.142200	113.967872	WINTER	NONE	S
08-Dec-25	5	1217	FP	2	SWL	2	321	ON	3RS ET – OPER	22.154877	113.901939	WINTER	NONE	S
08-Dec-25	6	1222	FP	2	SWL	2	84	ON	3RS ET – OPER	22.161677	113.898456	WINTER	NONE	S
08-Dec-25	7	1238	FP	2	SWL	2	120	ON	3RS ET – OPER	22.186436	113.904689	WINTER	NONE	S
08-Dec-25	8	1316	FP	3	SWL	2	95	ON	3RS ET – OPER	22.161580	113.896768	WINTER	NONE	P
08-Dec-25	9	1320	FP	1	SWL	2	98	ON	3RS ET – OPER	22.154988	113.896977	WINTER	NONE	P
08-Dec-25	10	1331	FP	1	SWL	2	85	ON	3RS ET – OPER	22.158479	113.887167	WINTER	NONE	P
08-Dec-25	11	1514	CWD	3	SWL	2	107	ON	3RS ET – OPER	22.191543	113.849723	WINTER	PURSE SEINER	P
10-Dec-25	1	1102	CWD	1	WL	2	176	ON	3RS ET – OPER	22.241438	113.839505	WINTER	NONE	P
11-Dec-25	1	1040	FP	2	SWL	2	134	ON	3RS ET – OPER	22.184708	113.935575	WINTER	NONE	P
11-Dec-25	2	1049	FP	1	SWL	2	26	ON	3RS ET – OPER	22.167200	113.935918	WINTER	NONE	P
11-Dec-25	3	1309	FP	3	SWL	2	84	ON	3RS ET – OPER	22.154367	113.896635	WINTER	NONE	P
11-Dec-25	4	1323	FP	3	SWL	2	20	ON	3RS ET – OPER	22.164436	113.886820	WINTER	NONE	P
11-Dec-25	5	1327	FP	1	SWL	2	177	ON	3RS ET – OPER	22.171225	113.887256	WINTER	NONE	P
11-Dec-25	6	1434	CWD	5	SWL	2	32	ON	3RS ET – OPER	22.197808	113.868531	WINTER	NONE	P
11-Dec-25	7	1522	CWD	8	SWL	2	410	ON	3RS ET – OPER	22.191997	113.849127	WINTER	NONE	P
12-Dec-25	1	1029	CWD	1	NWL	3	339	ON	3RS ET – OPER	22.285077	113.870355	WINTER	NONE	P
15-Dec-25	1	1127	CWD	7	WL	3	334	ON	3RS ET – OPER	22.213927	113.834407	WINTER	NONE	P
15-Dec-25	2	1153	CWD	5	WL	2	63	ON	3RS ET – OPER	22.205401	113.837040	WINTER	NONE	P
15-Dec-25	3	1225	CWD	10	WL	2	276	ON	3RS ET – OPER	22.196281	113.833846	WINTER	NONE	P
15-Dec-25	4	1301	CWD	9	WL	2	443	ON	3RS ET – OPER	22.187519	113.839214	WINTER	NONE	P

Abbreviations: STG# = Sighting Number; GP SZ = Dolphin Group Size; BEAU = Beaufort Sea State; PSD = Perpendicular Distance (in metres); N/A = Not Applicable;
DEC LAT = Latitude (WGS84 in Decimal), DEC LON = Longitude (WGS84 in Decimal); BOAT ASSOC. = Fishing Boat Association

CWD Small Vessel Line-transect Survey

Photo Identification – Residency Pattern of Selected Dolphin Individuals

ID	Residency	2015	2016	2017	2018	2019	2020	2021	2022				2023				2024				2025				#STG
									SP	SU	AU	WI	SP	SU	AU	WI	SP	SU	AU	WI	SP	SU	AU	WI	
NLMM001	SV		1	1	3	4		2						1	2	1									15
NLMM002	SV		8	2	4	1																			15
NLMM004	SV		4	7	7	6	2																		26
NLMM006	SV		10	1	5	4																			20
NLMM009	SV		3	6	5	2	2	7		1						2									28
NLMM013	SR		10	2	7	5	1	4			1	1		1		1	1	3		1	1	2		1	42
NLMM015	SV		1	3	5	2	3	7		2	1					1									25
NLMM016	SV		1	5	2	6		1		1		1	2		1	1									21
NLMM019	SV		4	7	2	6	1																		20
NLMM020	SV		2	7	2	4	1	2					2	1		1	1								23
NLMM023	SR		2	5	6	1	2	4			1				2			3		1	1	1		1	30
NLMM027	SR		2	3		2	1	2		1	1		2	1		2		1		1		1		1	21
NLMM028	SR		4	3	1						1	1			1	1		3				1			16
NLMM052	SV			3	4	1	2	3	1							2		1				1	1		16
NLMM063	SV				9	6	3	3		1		1		1	1			1							17
SLMM002	SR	1	6	1	3	5	5		3	4	3		1	2	1	2	1	2	1	1		1		1	28
SLMM003	YR	1	3	1	9	8	16	10	4	1			4	2	3	2	2	3	1	5					42
SLMM007	YR	1	4	3	4	5	9	6	1		1	5	3	2	1	1	1	1		2	5	5	1	1	87
SLMM011	SV		7	6		3	2																		58
SLMM012	SV	1	3	2	4	7	9	8	5	2		1													18
SLMM014	SV		8	11	7	4	12	13		5	2		4	1	1	2	3	2	2	1					42
SLMM022	YR		7	3	2	5	3	2						3	1						1	2		2	83

ID	Residency	2015	2016	2017	2018	2019	2020	2021	2022				2023				2024				2025				#STG
									SP	SU	AU	WI	SP	SU	AU	WI	SP	SU	AU	WI	SP	SU	AU	WI	
SLMM023	SV		2	7	2	1	8	3		1	3	1	3	2	1	1	1	3	1			1		3	30
SLMM025	YR		1	1	1	3	7	3	4	1	1		3			1	1	1		1	4	1	2	1	48
SLMM027	SR		1	3	5	1	2	3	1	1			6	1			1	2		1		3		1	33
SLMM028	SR		5	5	6	4	4														1		2	31	
SLMM029	SV		2		1	3		2	1	1	1	1		2			1	1							24
SLMM030	SV		4	6	3	2	2	3				1				1		1							16
SLMM031	SV		4	5	2	2	7	5			1	1	3			5	1		2					1	24
SLMM034	SR		3	2	4	3	5	2		1			1		2	2		1			4				42
SLMM035	SR		1		1	1	2	2		1	2	2	3			3		1			1	1			28
SLMM037	SR		3	4	2	5	12	15	2	5	3	2	5	3	1	2	1			1	1				20
SLMM044	SV		2		4	1	2		3	1	2	4	4	3	2	2									66
SLMM049	SV		2	3	3	7	8	4		1	3	1	5	1	2			5	1						30
SLMM050	SR		1	2		3	3			2			1			1		4				2	1		49
SLMM052	SR	1	1	7	5	8	9	3	3	1	1	1	1	6	1		1	3		5	1				18
SLMM058	SR			1	4	2	3	4			2		3			3		1			2	3		3	65
SLMM060	SV			1	3	2	2	4	2	2	1		1	1	2		1	1							23
SLMM073	SR						1	5				4	2	2		1	1					2			25
WLMM001	YR	1	1	8	11	5	7	8	3		1	4	2	3	1	1		5	1	3	3	1	1	1	22
WLMM003	SR	1	1	3	2	2	4	1		3		3	1		3			5			1	1	1		68
WLMM004	SR	1		3	5	4	2	3		1				1			1	1				1	1		31
WLMM005	SR	1	2		1	2	2		2			1	1	1				2				1	2	2	27
WLMM006	SR	1	1	4	6	3	3	2														1	1		17
WLMM007	SV	1	4	6	4	6	9	5		1	2		3	3	3	1	1	3		3					20
WLMM008	SR	1	1	6	1	3	3	1										1					1	5	61

ID	Residency	2015	2016	2017	2018	2019	2020	2021	2022				2023				2024				2025				#STG
									SP	SU	AU	WI	SP	SU	AU	WI	SP	SU	AU	WI	SP	SU	AU	WI	
WLMM009	SV	1	1	4	5	1	4	1										1							17
WLMM018	SV		3	3	2	1	4	1		1	2		1	1				1	1	1				1	19
WLMM019	SR		1	3	2	2	1	3		2		1				1						3	1		26
WLMM027	SV		9	6	7	5	2	1				2	1				1		1	1					16
WLMM028	SR		4	2	6	1	7	5				2	1	3		1				1		1			37
WLMM029	SR		3	2	6	4	4	4		1	1	2	1			1	1			1			1		34
WLMM030	SR		4	3	1	2	3	2						2							1			1	33
WLMM043	SV		3	6	6	8	3	9	2		1		2	1	2	2		2		1					17
WLMM049	SR		3	2	1	3				4		1						1			1			3	52
WLMM054	SV		3	4	6	7		1													1	3			19
WLMM056	SV		1	3	4	7	5	4	5	3	1		6	1	3	1	2	1		2					21
WLMM060	SR		1	4	7	2	4														4			2	55
WLMM063	SV		1	3	5	4	2	4	1	2		1	2			1		2							18
WLMM065	SR			5	6	4	2	4				3	1		2	1		2	2			1	1	2	32
WLMM067	SR			2	1	6		3	2	3		2	2	1		1	1	1		1		1	1	1	35
WLMM071	YR			6	9	3	4	6	1	1	1			2	1	1	1	2		1	1	1	1	1	30
WLMM073	SR			2	3	2	7	3	2			1	3	1				2		1		1	1		41
WLMM078	SR			3	6	6																2	1		30
WLMM079	SV			5	5	10	9	7	3	2		1	3	3	1	1		2		2					15
WLMM109	YR				4	1	3		2	1	1	1	1		1	1		4		1	2	1	1	2	60
WLMM114	SR				6	2	12	9	3		2	2	4	1		1		4		3	1			3	17
WLMM118	SR																					1	1		23
WLMM131	YR				1	6	8	9		3	3	1									1	5	3	1	59
WLMM147	SR					2	6	1		1			1	2		1		1		2		2		1	17

* Residency: YR = Year-round Resident; SR = Seasonal Resident; SV = Seasonal Visitor
Seasons: AU = Autumn; SP = Spring; SU = Summer; WI = Winter,
#STG = Total number of sightings

Annex 1 List of References (Tom, Bernd and Sarah to update)

CWD Monitoring:

- Buckland, S. T., D. R. Anderson, K. P. Burnham, J. L. Laake, D. L. Borchers and L. Thomas. 2001. Introduction to Distance Sampling: Estimating Abundance of Biological Populations. Oxford University Press.
- Buckland, S. T., D. R. Anderson, K. P. Burnham, J. L. Laake, D. L. Borchers and L. Thomas. 2004. Advanced Distance Sampling. Oxford University Press.
- Buckstaff, K.C., Wells, R.S., Gannon, J.G., Nowacek, D.P. 2013. Responses of bottlenose dolphins (*Tursiops truncatus*) to construction and demolition of coastal marine structures. Aquat. Mamm. 39, 174-186. (doi: 10.1578/AM.39.2.2013.174)
- Castellote, M., Clark, C.W., Lammers, M.O. 2012. Acoustic and behavioral changes by fin whales (*Balaenoptera physalus*) in response to shipping and airgun noise. Biol. Conserv. 147, 115-122. (doi:10.1016/j.biocon.2011.12.021)
- Chen, T., Hung, S.K., Qiu, Y., Jia, X. & Jefferson, T.A. 2010. Distribution, abundance, and individual movements of Indo-Pacific humpback dolphins (*Sousa chinensis*) in the Pearl River Estuary, China. Mammalia, 74, 117-125.
- Chilvers, B. L., P. J. Corkeron and M. L. Puotinen. 2003. Influence of trawling on the behaviour and spatial distribution of Indo-Pacific bottlenose dolphins (*Tursiops aduncus*) in Moreton Bay, Australia. Canadian Journal of Zoology 81:1947-1955.
- Finneran, J.J., Schlundt, C.E., Branstetter, B.K., Trickey, J.S., Bowman, V., Jenkins, K. 2015. Effects of multiple impulses from a seismic air gun on bottlenose dolphin hearing and behavior. J. Acoust. Soc. Amer. 137, 1634-1646. (doi: <http://dx.doi.org/10.1121/1.4916591>)
- Gailey, G. & Ortega-Ortiz, J.G. 2002. A note on a computer-based system for theodolite tracking of cetaceans. Journal of Cetacean Research and Management, 4, 213-218.
- Gailey, G., Würsig, B. & McDonald, T.L. 2007. Abundance, behavior, and movement patterns of western gray whales in relation to a 3-D seismic survey, Northeast Sakhalin Island, Russia. Environmental Monitoring and Assessment, 134, 75-91.
- Hastie T., Tibshirani R. 1986. Generalized additive models. Statistical Science:297-310.
- Hoyt, E. 2011. Marine Protected Areas for Whales, Dolphins, and Porpoises, Second Edition. Earthscan Press, London, UK. 464 pp.
- Huang, S., Karczmarski, L., Chen, J., Zhou, R., Wen, L., Zhang, H., Li, H. & Wu, Y. 2012. Demography and population trends of the largest population of Indo-Pacific humpback dolphins. Biological Conservation, 147:234-242.
- Huang Z, Fang L, Wen H, Zhang K, Wang X and Chen T (2024) Responses of Indo-Pacific humpback dolphins (*Sousa chinensis*) to construction of the Hong Kong–Zhuhai–Macao Bridge. Front. Mar. Sci. 11:1407937. doi: 10.3389/fmars.2024.1407937
- Hung, S.K.Y. & Jefferson, T.A. (2004). Ranging patterns of Indo-Pacific humpback dolphins in the Pearl River Estuary. Aquatic Mammals, 30, 159–174.
- Hung, S.K. 2008. Habitat use of Indo-Pacific humpback dolphins (*Sousa chinensis*) in Hong Kong. Ph.D. dissertation. University of Hong Kong, Hong Kong, 266 p.

Hung, S.K. 2016. Monitoring of Marine Mammals in Hong Kong Waters (2015 – 2016) Final Report (1 April 2015 to 31 March 2016). Agriculture, Fisheries and Conservation Department of the Hong Kong SAR Government.

Jefferson, T.A. 2000. Population biology of the Indo-Pacific hump-backed dolphin in Hong Kong waters. *Wildlife Monographs*, 144, 65 pp.

Jefferson, T.A. 2018. Hong Kong's Indo-Pacific humpback dolphins (*Sousa chinensis*): Assessing past and future anthropogenic impacts and working toward sustainability. *Aquatic Mammals* 44:711-728.

Jefferson, T.A. and S. Leatherwood. 1997. Distribution and abundance of Indo-Pacific hump-backed dolphins (*Sousa chinensis* Osbeck, 1765) in Hong Kong waters. *Asian Marine Biology* 14:93-110.

Jefferson, T. A., E. A. Becker and S. L. Huang. (2023). Influences of natural and anthropogenic habitat variables on Indo-Pacific humpback dolphins *Sousa chinensis* in Hong Kong. *Endangered Species Research*, 51, 143-160. <https://doi.org/10.3354/esr01249>

Lammers, M.O., Brainard, R.E., Au, W.W.L., Mooney, T.A. & Wong, K.B. 2008. An ecological acoustic recorder (EAR) for long-term monitoring of biological and anthropogenic sounds on coral reefs and other marine habitats. *Journal of the Acoustical Society of America*, 123, 1720-1728.

Lundquist, D., Gemmell, N.J. & Würsig, B. 2012. Behavioural responses of dusky dolphin groups (*Lagenorhynchus obscurus*) to tour vessels off Kaikoura, New Zealand. *PLoS ONE*, 7, 9pp.

Lusseau, D. 2006. The short-term behavioral reactions of bottlenose dolphins to interactions with boats in Doubtful Sound, New Zealand. *Marine Mammal Science*, 22(4), 802-818.

Marques, F. F. C. and S. T. Buckland. 2003. Incorporating covariates into standard line transect analyses. *Biometrics* 59:924-935.

Marques, F. F. C. and S. T. Buckland. 2004. Covariate models for the detection function. Pages 31-47 in S. T. Buckland, D. R. Anderson, K. P. Burnham, J. L. Laake, D. L. Borchers and L. Thomas, eds. *Advanced Distance Sampling*. Oxford University Press.

Mott MacDonald. 2014. Expansion of Hong Kong International Airport into a Three-Runway System Environmental Impact Assessment Report. The Airport Authority Hong Kong, Hong Kong.

Munger, L., Lammers, M.O., Cifuentes, M., Würsig, B., Jefferson, T.A. & Hung, S.K. 2016. Indo-Pacific humpback dolphin occurrence north of Lantau Island, Hong Kong, based on year-round passive acoustic monitoring. *Journal of the Acoustical Society of America*, 140, 2754–2765.

Mott MacDonald 2014. Expansion of Hong Kong International Airport into a Three-Runway System. Environmental Impact Assessment Report. Final report to the Hong Kong SAR Government.

Mott MacDonald 2019. Chinese White Dolphin Monitoring Annual Review Report – January 2018 to December 2018. Final report to the Hong Kong SAR Government.


Nowacek, D.P., Thorne, L.H., Johnston, D.W., Tyack, P.L. 2007. Responses of cetaceans to anthropogenic noise. *Mamm. Rev.* 372, 81-115. (doi: 10.1111/j.1365-2907.2007.00104.x)

Parsons, E.C.M. (2004). The behavior and ecology of the Indo-Pacific humpback dolphin (*Sousa chinensis*). *Aquatic Mammals*, 30(1), 38–55

Piwetz, S., Hung, S., Wang, J., Lundquist, D. & Würsig, B. 2012. Influence of vessel traffic on movements of Indo-Pacific Humpback dolphins (*Sousa chinensis*) off Lantau Island, Hong Kong. *Aquatic Mammals*, 38, 325-331.

- Quinn, G. P., & Keough, M. J. 2002. Experimental design and data analysis for biologists. Cambridge University Press.
- Rolland, R.M., Parks, S.E., Hunt, K.E., Castellote, M., Corkeron, P.J., Nowacek, D.P., Wasser, S.K., and Kraus, S.D. 2012. Evidence that ship noise increases stress in right whales. *Proc. R. Soc. B* 279, 2363-2368. (doi: 10.1098/rspb.2011.2429)
- Sims, P.Q., Vaughn, R., Hung, S.K. & Würsig, B. 2012a. Sounds of Indo-Pacific humpback dolphins (*Sousa chinensis*) in West Hong Kong: A preliminary description. *J. Acoust. Soc. Am.* 131: EL48-EL53.
- Sims, P.Q., Hung, S.K. & Würsig, B. 2012b. High-speed vessel noises in West Hong Kong waters and their contributions relative to Indo-Pacific humpback dolphins (*Sousa chinensis*). *Journal of Marine Biology*, 2012, 11 pp.
- Thomas, L., S. T. Buckland, E. A. Rexstad, J. L. Laake, S. Strindberg, S. L. Hedley, J. R. B. Bishop, T. A. Marques and K. P. Burnham. 2010. Distance software: design and analysis of distance sampling surveys for estimating population size. *Journal of Applied Ecology* 47:5-14.
- Turchin, P. 1998. Quantitative Analysis of Movement: Measuring and modelling population redistribution in animals and plants. Sinauer Associates, Inc., U.S.A.
- Wiggins, S.M. & Hildebrand, J. 2007. High-frequency Acoustic Recording Package (HARP) for broadband, long-term marine mammal monitoring. In: *Symposium on Underwater Technology and Workshop on Scientific Use of Submarine Cables and Related Technologies* (ed. by Anonymous), pp. 551-557.
- Wood S. 2006. Generalized additive models: an introduction with R CRC press.
- Würsig, B., Cipriano, F. & Würsig, M. 1991. Dolphin movement patterns: information from radio and theodolite tracking studies. In: *Dolphin societies: Discoveries and puzzles* (ed. by K. Pryor & K.S. Norris), pp. 79-111. University of California Press.

Reference: Additional Vessel Survey for CWD Monitoring in Deep Bay Area

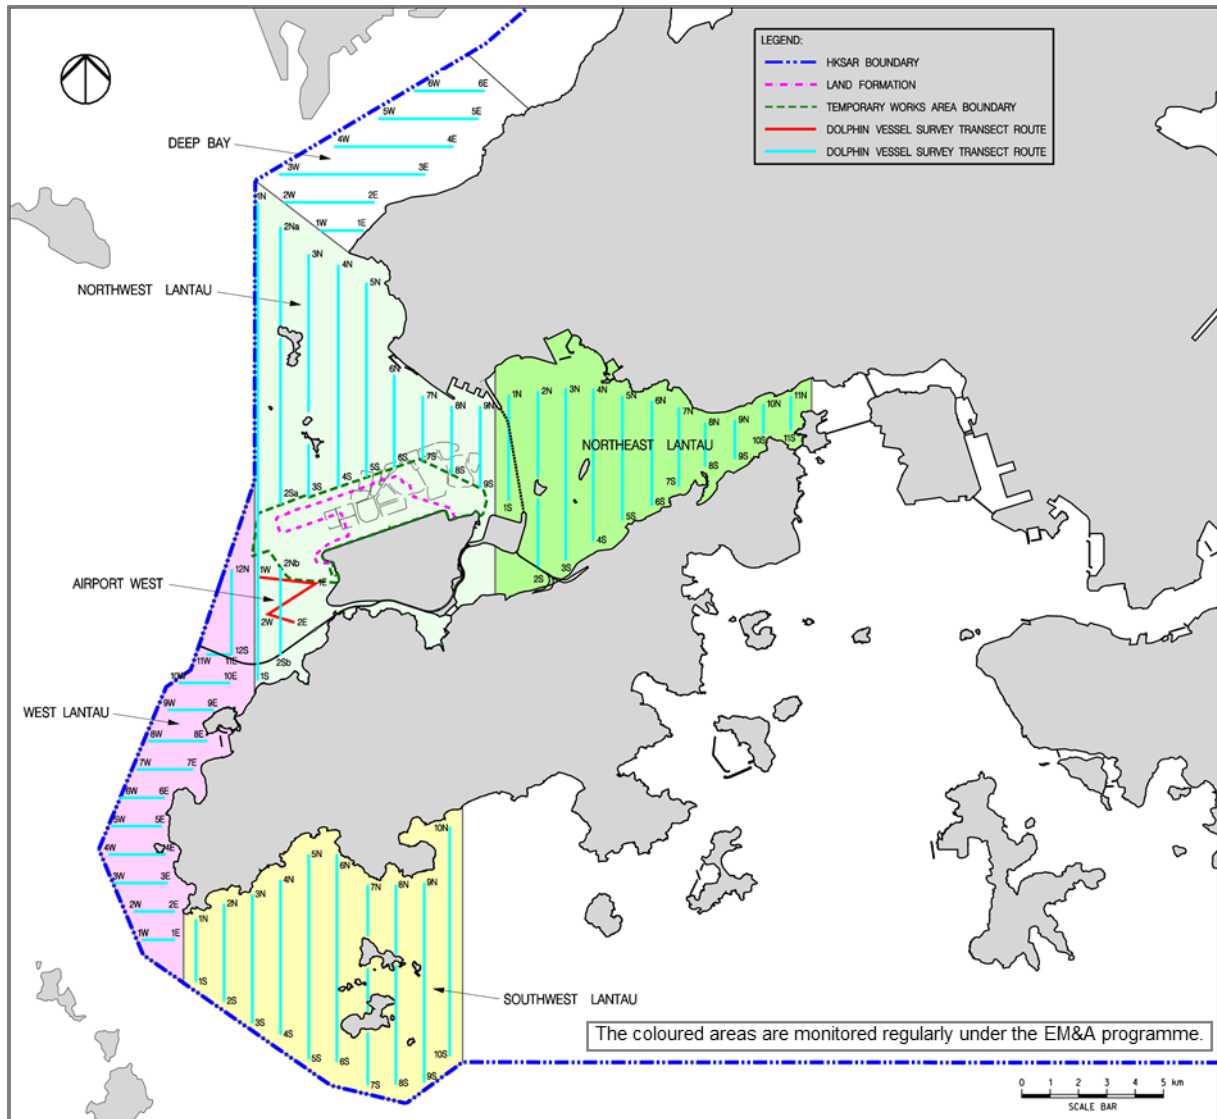


The additional survey in Deep Bay (DB) was conducted on a voluntary basis at the same frequency of two surveys per month.

All DB data were for reference and used only for density and abundance estimation.

(Note: The transect route in the DB survey area could not be fully travelled due to obstruction by the existing oyster culture rafts.)

Appendix E.1. Voluntary Supplementary Surveys Result

Figure 1: Locations of PAM Setups

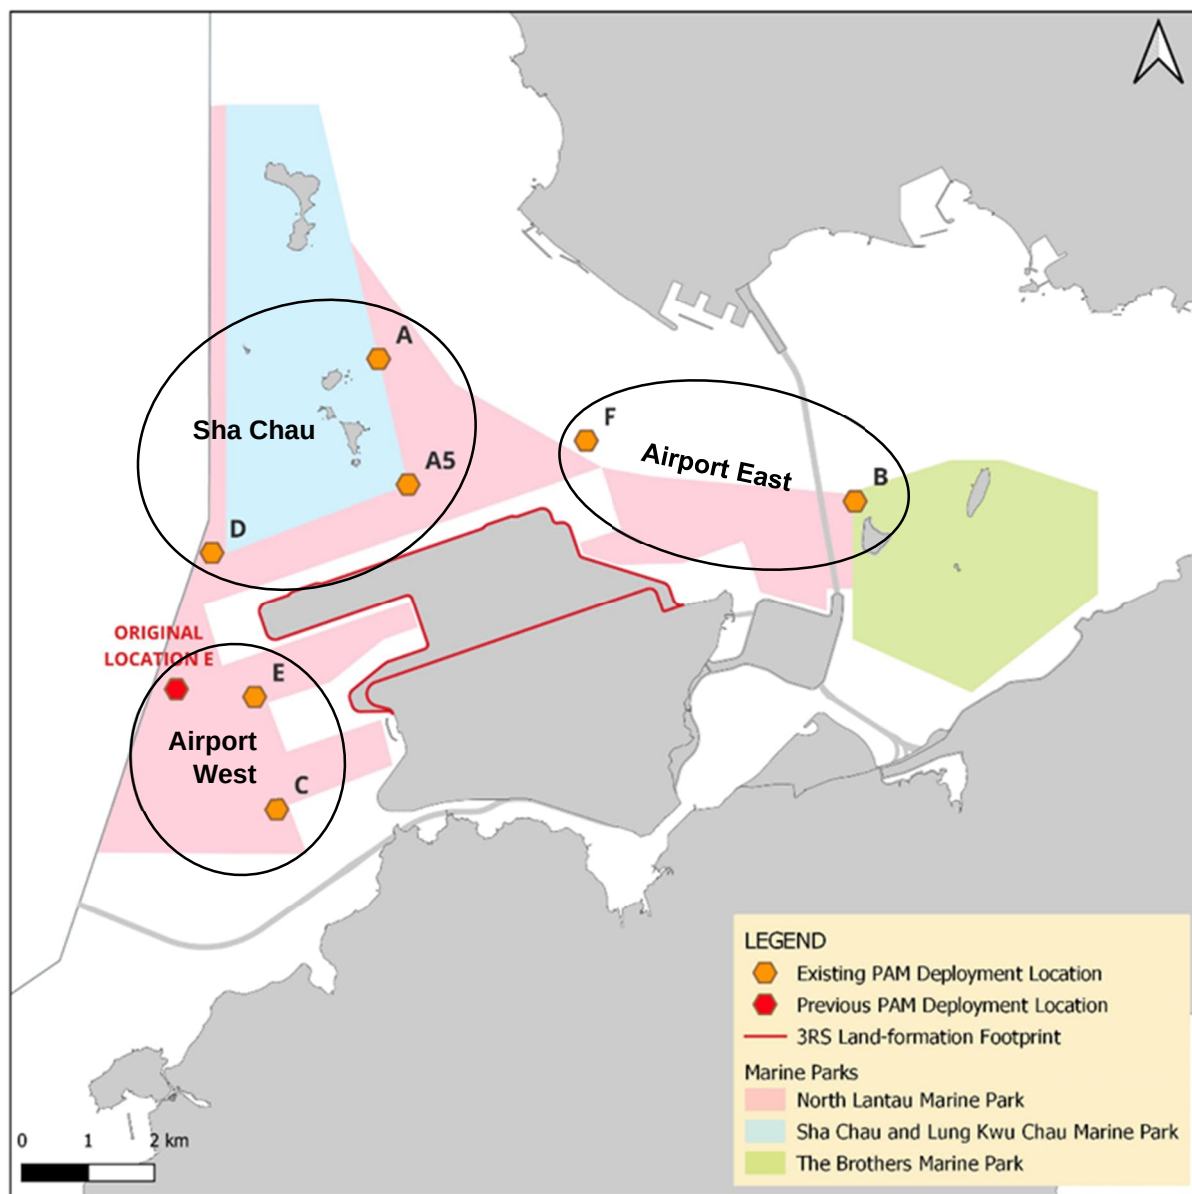

Remark:

F-POD was deployed at the original Location E between May 2022 and October 2024. The updated Location E has been in use since November 2024.

Figure 2: Trend of PAM Survey Results from 2022 to 2025


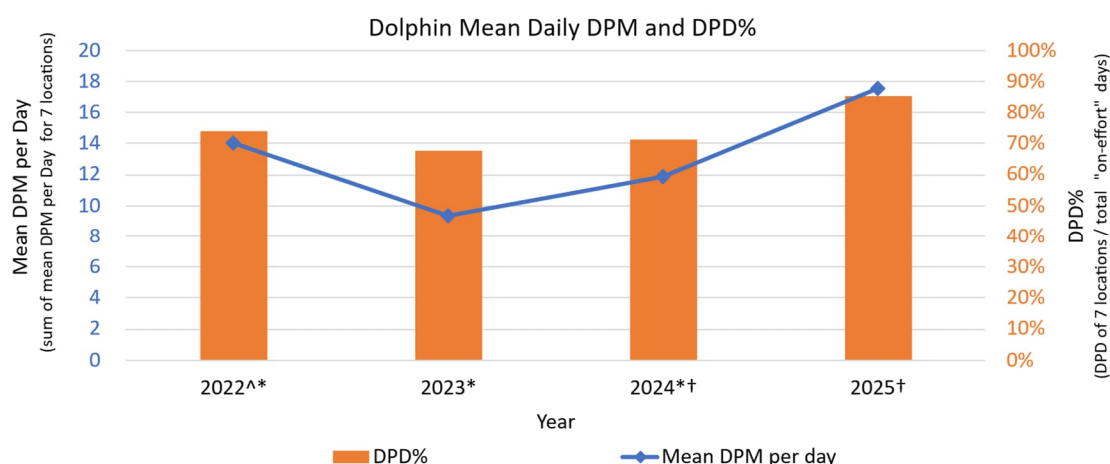


Figure 3: Trend of PAM Survey Results from 2022 to 2025, Analysis via Grouping the Results by Areas

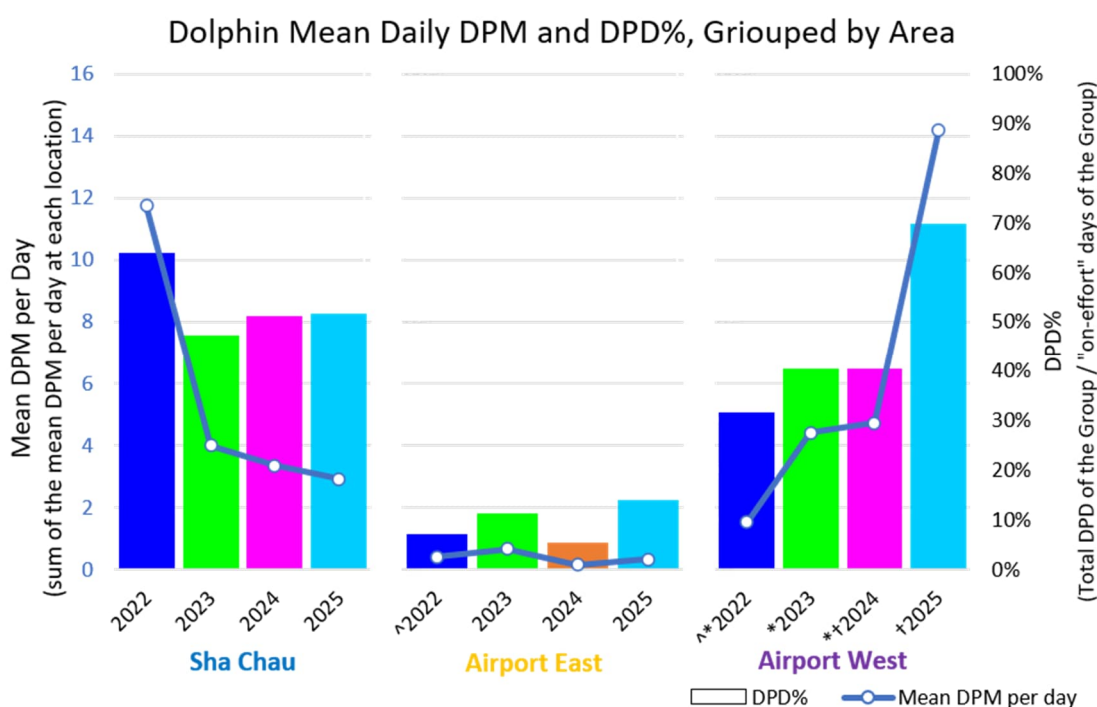


Annotations for **Figures 2 - 3**:

- DPD = detection positive days (days with one or more dolphin detections);
- DPM = detection positive minutes (minutes with one or more dolphin detection)
- Mean DPM per day = total DPM / "On-effort" days
- "DPD%" is the detection positive days as a percentage of total "On-effort" days.

Note for **Figures 2 - 4**:

- FPOD has been used to replace EAR since late December 2020;
- This table presents F-POD data collected at Location A5 during 3RS EM&A activities and Rebound Surveys. Location A5 was the previous PAM station under 3RS EM&A programme. A5 was added to the Rebound Surveys 2022-2023 in January 2024, and has been continued for use in Rebound Surveys 2024-2025, 2025-2026.
- ^ The monitoring at Locations E and F commenced on 12 May 2022
- * Significant data loss at Location E due to several occasions of device error and F-POD loss, i.e. 155 days from 12 Oct 2022 to 15 Mar 2023, 90 days from 9 Mar to 6 Jun 2024, and 110 days from 2 Aug to 29 Nov 2024
- † On 30 Nov 2024, Location E of West of the 3RS close to the Hong Kong marine waters boundary was relocated to Southwest of the 3RS with better protection

Figure 4: Total Dolphin DPM per Hour of Day, 2022 to 2025

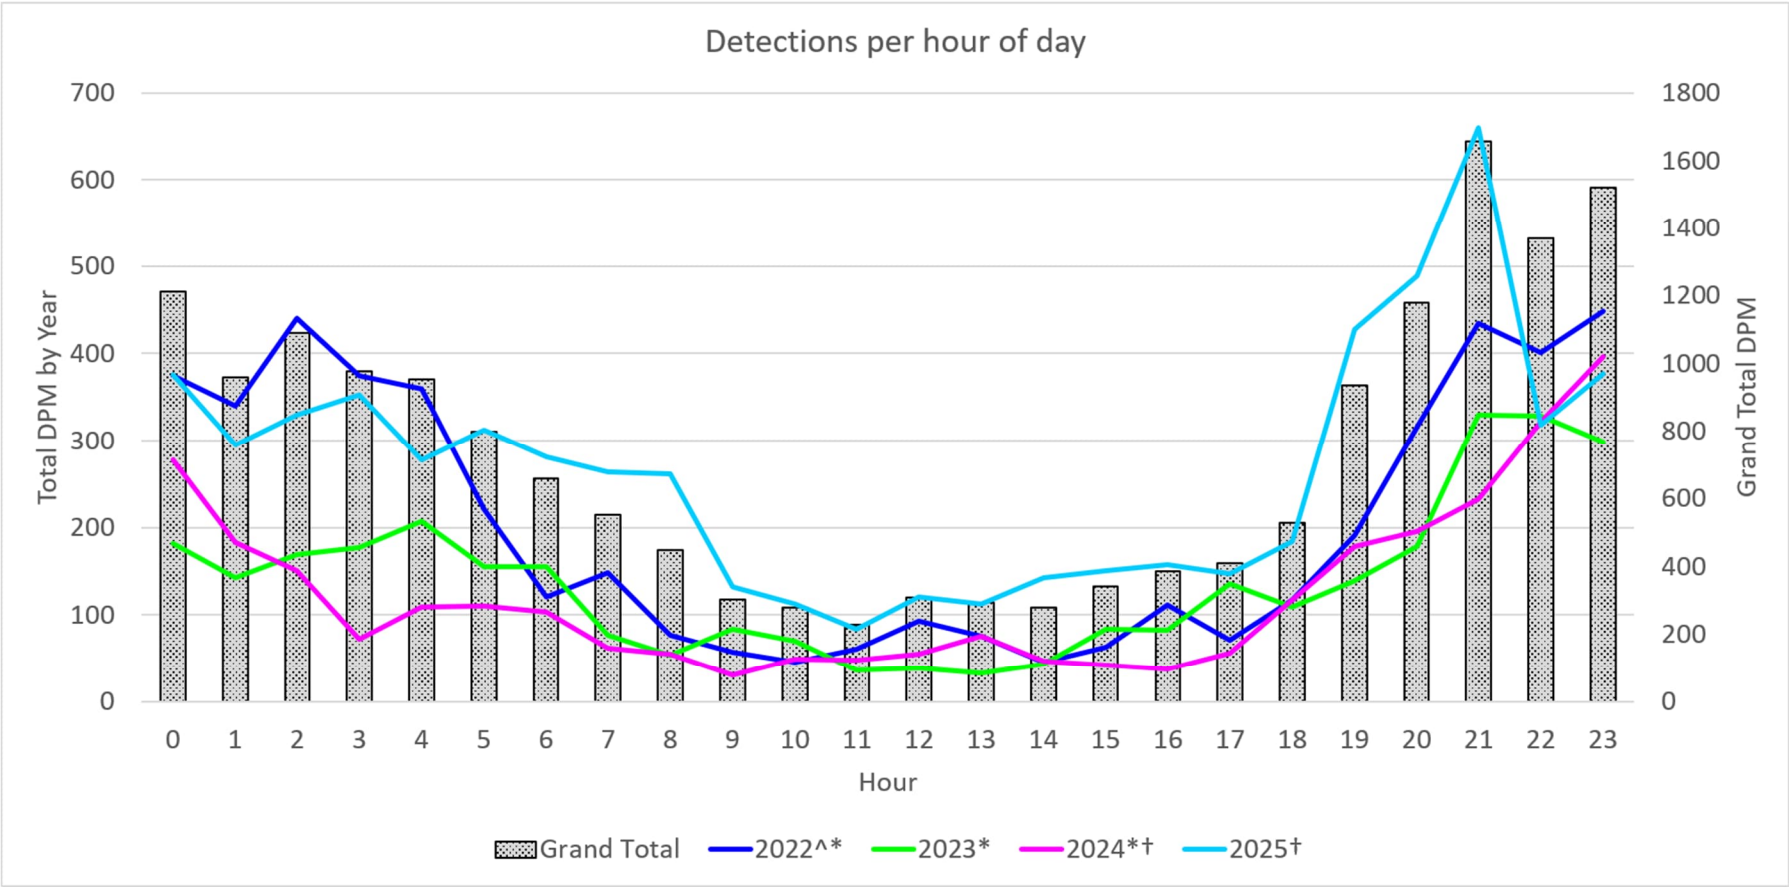

Appendix F. Summary of Environmental Complaints and Cumulative Statistics on Exceedances, Notification of Summons, and Prosecution

Summary of Environmental Complaints

Date of Complaint Received	Details	Analysis / Remedial Actions	Status
14 January 2025	A complaint regarding dust nuisance at 3RS construction site was received.	ET requested the relevant contractors to provide information regarding the complaint and replies indicated cleaning works were carried out inside the North Wing Level 6 of Terminal 2 Concourse. The relevant contractor improved their dust mitigation measures by wetting the floor and using a mist sprayer prior to undertaking the cleaning works; and conducting refresher training with frontline cleaning workers on dust suppression measures for cleaning works. During the ET's site inspections, no dust related item was recorded. The relevant contractor was reminded to keep review their dust mitigation measures and to enhance dust suppression measures before conducting cleaning and other dusty works to prevent dust nuisance. Hence, the case was considered closed.	Closed
25 April 2025	A complaint regarding dust nuisance at 3RS construction site was received.	The ET initiated an investigation. The relevant contractor confirmed that mixing works had been conducted in the area. Prior to resuming such activities, dust mitigation measures were enhanced and training was provided to workers. The ET conducted site inspections and did not observe any dust-related items. The contractor was reminded to continue reviewing dust control measures and ensure proper training is provided before future mixing works. Based on the findings, the complaint case is considered resolved and closed.	Closed
7 August 2025	A complaint regarding dust nuisance at 3RS construction site was received.	The ET initiated an investigation and identified the concerned area as the Terminal 2 Concourse haul road. The relevant contractor explained that the way the two water trucks were deployed had reduced the effectiveness of dust suppression along the haul road. The arrangement was adjusted, dust mitigation measures were enhanced, and refresher training was provided to workers. The ET conducted site inspections and did not observe any dust-related items. The contractor was reminded to continue reviewing dust control measures at the concerned haul road. Based on the findings, the complaint case is considered resolved and closed.	Closed

Cumulative Statistics for Valid Exceedances for the Environmental Monitoring

		Total no. recorded in the reporting period	Total no. recorded since the project commenced
1-hr TSP	Action	0	0
	Limit	0	0
Noise	Action	0	0
	Limit	0	0
Waste	Action	0	1
	Limit	0	0
Water	Action	Nil ⁽²⁾	0
	Limit	Nil ⁽²⁾	0
CWD	Action	Nil ⁽³⁾	0
	Limit	Nil ⁽³⁾	0

Remark: 1) Exceedances, which are not found project related, are not shown in this table.

2) With the completion of land formation works including seawall construction and all marine filling works in the first quarter of 2023, the construction phase water quality impact monitoring was terminated after 31 October 2023. No water quality impact monitoring was undertaken during the reporting period.

3) Construction phase CWD monitoring by small vessel line-transect survey supplemented by land-based theodolite tracking survey and passive acoustic monitoring was completed in December 2023. No CWD impact monitoring was undertaken during the reporting period.

Cumulative Statistics for Non-compliance, Complaints, Notifications of Summons and Prosecution

Reporting Period	Cumulative Statistics			
	Non-compliance	Complaints	Notifications of Summons	Prosecutions
This reporting period	0	3	0	0
From 28 December 2015 to end of the reporting period	0	83	2	2

Appendix G. Tree Schedule

Appendix G

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
Existing Works Contracts													
3302	T05		3302	811170.337	818121.173	大葉合歡	<i>Albizia lebbbeck</i>	354	7	8	FELL	FELL	
3302	T01	AAHK	811275.297	818150.991	王棕	<i>Roystonea regia</i>	330	3	11	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T02	3302	811264.902	818147.829	鳳凰木	<i>Delonix regia</i>	310	7	10	FELL	FELL	FELL	
3302	T03	AAHK	811263.970	818145.696	王棕	<i>Roystonea regia</i>	340	3	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T04	AAHK	811197.022	818119.301	木棉	<i>Bombax ceiba</i>	400	7	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T06		3302	811162.015	818120.276	苦楝	<i>Melia azedarach</i>	350	10	10	FELL	FELL	
3302	T07	AAHK	811156.704	818109.776	銀海欖	<i>Phoenix sylvestris</i>	360	7	12	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T08	AAHK	811157.985	818104.865	榕樹	<i>Ficus microcarpa</i>	350	10	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T09	AAHK	811154.973	818114.253	雞蛋花	<i>Plumeria rubra</i>	191	4	3.5	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T10	AAHK	811154.739	818117.318	垂葉榕	<i>Ficus benjamina</i>	450	5	5.5	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T11	AAHK	811162.660	818130.209	火焰木	<i>Spathodea campanulata</i>	370	6	10	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3302	T12	AAHK	811167.390	818133.426	蒲葵	<i>Livistona chinensis</i>	300	4	11	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Sept 2023.
3501	T2834	3501	811564.826	819989.263	銀樺	<i>Grevillea robusta</i>	95	2	4	FELL	FELL	FELL	
3501	T2840	3501	811583.814	820019.745	銀樺	<i>Grevillea robusta</i>	135	4	7	FELL	FELL	FELL	
3501	T2841	3501	811581.424	820017.802	銀樺	<i>Grevillea robusta</i>	135	3	6	FELL	FELL	FELL	
3501	T2842	3501	811579.389	820013.517	銀樺	<i>Grevillea robusta</i>	160	4	6	FELL	FELL	FELL	
3501	T2843	3501	811570.203	820021.011	銀樺	<i>Grevillea robusta</i>	125	3	6	FELL	FELL	FELL	
3501	T2844	3501	811569.526	820018.664	銀樺	<i>Grevillea robusta</i>	110	3	6	FELL	FELL	FELL	
3501	T2845	3501	811566.205	820014.999	銀樺	<i>Grevillea robusta</i>	170	4	6	FELL	FELL	FELL	
3501	T2846	3501	811560.860	820016.716	銀樺	<i>Grevillea robusta</i>	165	4	8	FELL	FELL	FELL	
3501	T2847	3501	811557.684	820018.792	銀樺	<i>Grevillea robusta</i>	160	4	7	FELL	FELL	FELL	
3501	T2848	3501	811557.945	820015.551	銀樺	<i>Grevillea robusta</i>	150	4	7	FELL	FELL	FELL	
3501	T2849	3501	811553.484	820017.694	銀樺	<i>Grevillea robusta</i>	95	3	6	FELL	FELL	FELL	
3501	T2850	3501	811552.831	820014.626	銀樺	<i>Grevillea robusta</i>	105	3	5	FELL	FELL	FELL	
3501	T2851	3501	811553.571	820012.506	紅膠木	<i>Lophostemon confertus</i>	150	4	6	FELL	FELL	FELL	
3501	T2852	3501	811550.004	820027.267	苦楝	<i>Melia azedarach</i>	275	8	9	FELL	FELL	FELL	
3501	T2853	3501	811550.004	820028.299	苦楝	<i>Melia azedarach</i>	210	3	7	FELL	FELL	FELL	
3501	T2854	3501	811545.157	820031.346	苦楝	<i>Melia azedarach</i>	470	10	9	FELL	FELL	FELL	
3501	T2855	3501	811544.552	820031.723	苦楝	<i>Melia azedarach</i>	230	6	9	FELL	FELL	FELL	
3501	T2856	3501	811541.734	820025.226	耳果相思	<i>Acacia auriculiformis</i>	230	8	9	FELL	FELL	FELL	
3501	T2857	3501	811533.586	820023.626	洋紫荊	<i>Bauhinia x Blakeana</i>	175	4	5	FELL	FELL	FELL	
3501	T2858	3501	811544.246	820017.027	銀樺	<i>Grevillea robusta</i>	155	3	4	FELL	FELL	FELL	
3501	T2859	3501	811544.739	820005.874	銀樺	<i>Grevillea robusta</i>	105	3	6	FELL	FELL	FELL	
3501	T2860	3501	811544.339	820002.513	銀樺	<i>Grevillea robusta</i>	95	3	6	FELL	FELL	FELL	
3501	T2861	3501	811536.815	820015.382	銀樺	<i>Grevillea robusta</i>	120	2	5	FELL	FELL	FELL	
3501	T2862	3501	811535.419	820012.965	銀樺	<i>Grevillea robusta</i>	110	2	5	FELL	FELL	FELL	
3501	T2863	3501	811535.788	820009.776	銀樺	<i>Grevillea robusta</i>	125	3	5	FELL	FELL	FELL	
3501	T2864	3501	811532.010	820006.746	銀樺	<i>Grevillea robusta</i>	150	4	7	FELL	FELL	FELL	
3501	T2865	3501	811512.828	820010.789	垂葉榕	<i>Ficus benjamina</i>	185	4	7	FELL	FELL	FELL	
3501	T2866	3501	811515.806	819996.902	紅膠木	<i>Lophostemon confertus</i>	225	4	6	FELL	FELL	FELL	
3501	T2867	3501	811508.914	819997.550	垂葉榕	<i>Ficus benjamina</i>	160	4	5	FELL	FELL	FELL	
3501	T2868	3501	811507.267	820000.659	垂葉榕	<i>Ficus benjamina</i>	160	4	5	FELL	FELL	FELL	
3501	T2869	3501	811513.026	819988.862	銀樺	<i>Grevillea robusta</i>	155	3	8	FELL	FELL	FELL	
3501	T2870	3501	811506.500	819991.396	垂葉榕	<i>Ficus benjamina</i>	150	4	7	FELL	FELL	FELL	
3501	T2871	3501	811504.880	819988.678	垂葉榕	<i>Ficus benjamina</i>	180	4	7	FELL	FELL	FELL	
3501	T2872	3501	811502.769	819988.202	垂葉榕	<i>Ficus benjamina</i>	180	4	7	FELL	FELL	FELL	
3501	T2873	3501	811500.947	819985.060	垂葉榕	<i>Ficus benjamina</i>	200	4	7	FELL	FELL	FELL	
3501	T2874	3501	811504.630	819985.165	垂葉榕	<i>Ficus benjamina</i>	165	4	7	FELL	FELL	FELL	
3501	T2875	3501	811503.555	819982.468	垂葉榕	<i>Ficus benjamina</i>	210	4	7	FELL	FELL	FELL	
3501	T2876	3501	811499.728	819980.100	垂葉榕	<i>Ficus benjamina</i>	190	4	7	FELL	FELL	FELL	
3501	T2877	3501	811499.980	819976.821	垂葉榕	<i>Ficus benjamina</i>	215	6	7	FELL	FELL	FELL	
3501	T2878	3501	811503.184	819978.072	垂葉榕	<i>Ficus benjamina</i>	205	6	7	FELL	FELL	FELL	
3501	T2879	3501	811503.642	819974.334	垂葉榕	<i>Ficus benjamina</i>	215	6	7	FELL	FELL	FELL	
3501	T2880	3501	811499.977	819973.587	垂葉榕	<i>Ficus benjamina</i>	160	4	7	FELL	FELL	FELL	
3501	T2881	3501	811502.953	819970.909	垂葉榕	<i>Ficus benjamina</i>	220	5	7	FELL	FELL	FELL	
3501	T2882	3501	811501.449	819968.218	垂葉榕	<i>Ficus benjamina</i>	240	7	7	FELL	FELL	FELL	
3501	T2885	3501	811524.395	819959.493	銀樺	<i>Grevillea robusta</i>	125	3	6	FELL	FELL	FELL	
3501	T2886	3501	811519.066	819956.518	銀樺	<i>Grevillea robusta</i>	100	3	6	FELL	FELL	FELL	
3501	T2887	3501	811514.400	819956.820	垂葉榕	<i>Ficus benjamina</i>	165	3	6	FELL	FELL	FELL	
3501	T2888	3501	811515.122	819948.868	垂葉榕	<i>Ficus benjamina</i>	250	6	7	FELL	FELL	FELL	
3501	T2889	3501	811518.986	819948.249	垂葉榕	<i>Ficus benjamina</i>	190	4	7	FELL	FELL	FELL	
3501	T2890	3501	811526.581	819949.787	垂葉榕	<i>Ficus benjamina</i>	230	5	7	FELL	FELL	FELL	
3501	T2891	3501	811527.204	819941.173	垂葉榕	<i>Ficus benjamina</i>	230	4	6	FELL	FELL	FELL	
3503	T1252	N/A	811942.889	819462.737	旅人蕉	<i>Ravenala madagascariensis</i>	320	2	4	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1253	N/A	811942.170	819462.076	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1254	N/A	811941.455	819461.627	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1255	N/A	811940.879	819461.577	旅人蕉	<i>Ravenala madagascariensis</i>	290	2	4	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1256	N/A	811940.544	819461.280	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1257	N/A	811938.751	819460.180	旅人蕉	<i>Ravenala madagascariensis</i>	190	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1258	N/A	811937.702	819458.816	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1259	N/A	811936.921	819457.860	旅人蕉	<i>Ravenala madagascariensis</i>	245	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1260	N/A	811936.154	819456.038	旅人蕉	<i>Ravenala madagascariensis</i>	210	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1278	N/A	811939.741	819459.409	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3503	T1280	N/A	811939.020	819458.955	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3503	T199	3503	811874.9683	819780.9829	耳果相思	Acacia auriculiformis	293	7	10	FELL	FELL	FELL	
3503	T200	3503	811867.3162	819782.114	苦楝	Melia azedarach	143	6	8	FELL	FELL	FELL	
3503	T245	3503	811846.5496	819771.2276	垂葉榕	Ficus benjamina	156	3	5	FELL	FELL	FELL	
3503	T246	3503	811845.3174	819768.2582	垂葉榕	Ficus benjamina	172	4	6	FELL	FELL	FELL	
3503	T247	3503	811848.2183	819767.3812	垂葉榕	Ficus benjamina	210	5	7	FELL	FELL	FELL	
3503	T248	3503	811847.5771	819764.0966	垂葉榕	Ficus benjamina	172	4	7	FELL	FELL	FELL	
3503	T249	3503	811849.7733	819763.4818	垂葉榕	Ficus benjamina	191	4	7	FELL	FELL	FELL	
3503	T250	3503	811851.512	819759.3679	垂葉榕	Ficus benjamina	200	5	7	FELL	FELL	FELL	
3503	T251	3503	811850.5332	819756.9545	垂葉榕	Ficus benjamina	140	5	7	FELL	FELL	FELL	
3503	T252	3503	811853.0333	819755.9432	垂葉榕	Ficus benjamina	225	4	7	FELL	FELL	FELL	
3503	T253	3503	811852.0991	819753.5101	垂葉榕	Ficus benjamina	145	3	6	FELL	FELL	FELL	
3503	T254	3503	811854.5348	819752.1039	垂葉榕	Ficus benjamina	135	4	7	FELL	FELL	FELL	
3503	T255	3503	811853.8168	819749.7097	垂葉榕	Ficus benjamina	190	4	7	FELL	FELL	FELL	
3503	T256	3503	811856.1014	819748.5197	垂葉榕	Ficus benjamina	165	4	6	FELL	FELL	FELL	
3503	T257	3503	811855.1171	819745.8945	垂葉榕	Ficus benjamina	160	4	7	FELL	FELL	FELL	
3503	T258	3503	811857.4192	819744.8442	垂葉榕	Ficus benjamina	230	5	7	FELL	FELL	FELL	
3503	T259	3503	811856.6922	819742.2958	垂葉榕	Ficus benjamina	170	5	7	FELL	FELL	FELL	
3503	T260	3503	811859.4105	819741.1989	垂葉榕	Ficus benjamina	165	4	7	FELL	FELL	FELL	
3503	T261	3503	811858.1933	819738.821	垂葉榕	Ficus benjamina	145	4	7	FELL	FELL	FELL	
3503	T262	3503	811860.8916	819737.4109	垂葉榕	Ficus benjamina	160	4	7	FELL	FELL	FELL	
3503	T263	3503	811859.7647	819734.9073	垂葉榕	Ficus benjamina	200	5	8	FELL	FELL	FELL	
3503	T264	3503	811862.3331	819733.8653	垂葉榕	Ficus benjamina	245	5	8	FELL	FELL	FELL	
3503	T265	3503	811861.3125	819731.1781	垂葉榕	Ficus benjamina	220	6	8	FELL	FELL	FELL	
3503	T266	3503	811863.7152	819730.2974	垂葉榕	Ficus benjamina	145	4	7	FELL	FELL	FELL	
3503	T267	3503	811863.0106	819727.6284	垂葉榕	Ficus benjamina	180	4	8	FELL	FELL	FELL	
3503	T268	3503	811865.3478	819726.4652	垂葉榕	Ficus benjamina	200	6	8	FELL	FELL	FELL	
3503	T269	3503	811864.8145	819723.7498	垂葉榕	Ficus benjamina	220	6	9	FELL	FELL	FELL	
3503	T2718	3503	811737.3118	819724.557	垂葉榕	Ficus benjamina	180	5	7	FELL	FELL	FELL	
3503	T2719	3503	811736.0886	819729.7665	垂葉榕	Ficus benjamina	135	4	5	FELL	FELL	FELL	
3503	T272	3503	811869.8078	819712.8991	垂葉榕	Ficus benjamina	180	4	7	FELL	FELL	FELL	
3503	T2720	3503	811733.9528	819732.6672	垂葉榕	Ficus benjamina	135	3	6	FELL	FELL	FELL	
3503	T2721	3503	811731.0087	819741.1771	垂葉榕	Ficus benjamina	125	3	5	FELL	FELL	FELL	
3503	T2722	3503	811729.0826	819747.1919	垂葉榕	Ficus benjamina	145	3	5	FELL	FELL	FELL	
3503	T2723	3503	811727.4899	819750.7511	垂葉榕	Ficus benjamina	110	3	5	FELL	FELL	FELL	
3503	T2724	3503	811725.4148	819756.9635	垂葉榕	Ficus benjamina	120	3	5	FELL	FELL	FELL	
3503	T2725	3503	811717.5441	819780.6435	垂葉榕	Ficus benjamina	150	4	6	FELL	FELL	FELL	
3503	T2726	3503	811716.1256	819783.8559	垂葉榕	Ficus benjamina	140	3	6	FELL	FELL	FELL	
3503	T2727	3503	811701.1278	819827.63	垂葉榕	Ficus benjamina	220	5	7	FELL	FELL	FELL	
3503	T2728	3503	811699.2648	819833.2894	垂葉榕	Ficus benjamina	170	3	6	FELL	FELL	FELL	
3503	T2729	3503	811698.0665	819836.5809	垂葉榕	Ficus benjamina	165	3	6	FELL	FELL	FELL	
3503	T273	3503	811871.533	819709.1063	垂葉榕	Ficus benjamina	180	4	7	FELL	FELL	FELL	
3503	T2730	3503	811696.5413	819840.9023	垂葉榕	Ficus benjamina	170	3	6	FELL	FELL	FELL	
3503	T2731	3503	811695.6629	819844.0416	垂葉榕	Ficus benjamina	135	3	5	FELL	FELL	FELL	
3503	T2732	3503	811694.5866	819847.0217	垂葉榕	Ficus benjamina	190	4	6	FELL	FELL	FELL	
3503	T2734	3503	811692.3213	819853.8894	垂葉榕	Ficus benjamina	180	3	6	FELL	FELL	FELL	
3503	T2735	3503	811691.1826	819856.653	垂葉榕	Ficus benjamina	180	3	7	FELL	FELL	FELL	
3503	T2737	3503	811671.2792	819863.96	垂葉榕	Ficus benjamina	170	4	6	FELL	FELL	FELL	
3503	T2738	3503	811667.5138	819865.5985	垂葉榕	Ficus benjamina	180	4	6	FELL	FELL	FELL	
3503	T2739	3503	811664.2252	819864.8028	垂葉榕	Ficus benjamina	125	3	6	FELL	FELL	FELL	
3503	T2740	3503	811665.6255	819861.8557	垂葉榕	Ficus benjamina	180	4	6	FELL	FELL	FELL	
3503	T2741	3503	811666.4677	819896.7604	黃槿	Hibiscus tiliaceus	265	8	8	FELL	FELL	FELL	
3503	T2742	3503	811663.587	819899.6396	黃槿	Hibiscus tiliaceus	155	7	7	FELL	FELL	FELL	
3503	T2743	3503	811662.9199	819902.2067	黃槿	Hibiscus tiliaceus	140	6	6	FELL	FELL	FELL	
3503	T2744	3503	811661.5425	819905.3429	黃槿	Hibiscus tiliaceus	190	7	6	FELL	FELL	FELL	
3503	T2745	3503	811660.5227	819908.1113	黃槿	Hibiscus tiliaceus	125	6	6	FELL	FELL	FELL	
3503	T2746	3503	811659.5621	819911.0754	黃槿	Hibiscus tiliaceus	150	6	6	FELL	FELL	FELL	
3503	T2747	3503	811659.0684	819913.1558	黃槿	Hibiscus tiliaceus	150	6	6	FELL	FELL	FELL	
3503	T2748	3503	811658.3119	819915.7848	黃槿	Hibiscus tiliaceus	155	7	5	FELL	FELL	FELL	
3503	T2749	3503	811657.3576	819918.9308	黃槿	Hibiscus tiliaceus	295	8	7	FELL	FELL	FELL	
3503	T275	3503	811874.7882	819701.2678	垂葉榕	Ficus benjamina	216	6	8	FELL	FELL	FELL	
3503	T2750	3503	811655.1594	819934.2419	垂葉榕	Ficus benjamina	170	4	6	FELL	FELL	FELL	
3503	T2751	3503	811660.2811	819936.2932	垂葉榕	Ficus benjamina	250	6	7	FELL	FELL	FELL	
3503	T2752	3503	811676.0981	819912.2405	黃槿	Hibiscus tiliaceus	285	8	8	FELL	FELL	FELL	
3503	T2753	3503	811674.8702	819915.7525	黃槿	Hibiscus tiliaceus	245	7	8	FELL	FELL	FELL	
3503	T2754	3503	811673.028	819926.0714	黃槿	Hibiscus tiliaceus	240	7	7	FELL	FELL	FELL	
3503	T2755	3503	811675.8052	819928.1589	黃槿	Hibiscus tiliaceus	215	6	7	FELL	FELL	FELL	
3503	T2756	3503	811677.6014	819932.0019	黃槿	Hibiscus tiliaceus	195	5	6	FELL	FELL	FELL	
3503	T2757	3503	811680.775	819933.2527	黃槿	Hibiscus tiliaceus	210	5	7	FELL	FELL	FELL	
3503	T2758	3503	811684.2845	819934.2151	黃槿	Hibiscus tiliaceus	230	7	8	FELL	FELL	FELL	
3503	T2759	3503	811689.3446	819936.2824	黃槿	Hibiscus tiliaceus	315	8	8	FELL	FELL	FELL	
3503	T276	3503	811876.5692	819697.608	垂葉榕	Ficus benjamina	185	4	7	FELL	FELL	FELL	
3503	T2760	3503	811679.4328	819944.6381	垂葉榕	Ficus benjamina	190	5	7	FELL	FELL	FELL	
3503	T2761	3503	811689.0292	819947.8907	垂葉榕	Ficus benjamina	230	6	8	FELL	FELL	FELL	
3503	T2762	3503	811707.4455	819941.5871	黃槿	Hibiscus tiliaceus	300	7	8	FELL	FELL	FELL	
3503	T2764	3503	811718.0322	819944.6888	黃槿	Hibiscus tiliaceus	215	6	6	FELL	FELL	FELL	
3503	T2765	3503	811723.8962	819944.8007	黃槿	Hibiscus tiliaceus	170	5	6	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3503	T2766	3503	811726.0197	819941.1453	黃槿	Hibiscus tiliaceus	190	6	7	FELL	FELL	FELL	
3503	T2767	3503	811728.6136	819942.1798	黃槿	Hibiscus tiliaceus	250	7	7	FELL	FELL	FELL	
3503	T2768	3503	811738.5728	819932.6347	銀樺	Grevillea robusta	120	3	6	FELL	FELL	FELL	
3503	T2769	3503	811740.1361	819930.3655	銀樺	Grevillea robusta	100	3	6	FELL	FELL	FELL	
3503	T277	3503	811878.5209	819693.5559	垂葉榕	Ficus benjamina	213	4	7	FELL	FELL	FELL	
3503	T2770	3503	811748.4875	819916.8297	銀樺	Grevillea robusta	180	4	9	FELL	FELL	FELL	
3503	T279	3503	811881.5847	819685.8313	垂葉榕	Ficus benjamina	194	4	7	FELL	FELL	FELL	
3503	T280	3503	811883.439	819682.1788	垂葉榕	Ficus benjamina	165	4	6	FELL	FELL	FELL	
3503	T281	3503	811884.8408	819678.4291	垂葉榕	Ficus benjamina	190	5	7	FELL	FELL	FELL	
3503	T282	3503	811896.353	819674.7187	垂葉榕	Ficus benjamina	260	6	8	FELL	FELL	FELL	
3503	T2817	3503	811633.646	820008.781	銀樺	Grevillea robusta	160	3	7	*	FELL	FELL	
3503	T2818	3503	811631.363	820008.663	銀樺	Grevillea robusta	135	3	7	*	FELL	FELL	
3503	T2819	3503	811629.539	820007.787	銀樺	Grevillea robusta	175	3	7	*	FELL	FELL	
3503	T2820	3503	811627.171	820007.147	銀樺	Grevillea robusta	125	3	7	*	FELL	FELL	
3503	T2821	3503	811625.252	820006.178	銀樺	Grevillea robusta	170	3	7	*	FELL	FELL	
3503	T2822	3503	811619.046	820004.472	銀樺	Grevillea robusta	190	3	7	*	FELL	FELL	
3503	T2823	3503	811616.539	820004.636	銀樺	Grevillea robusta	145	3	5	*	FELL	FELL	
3503	T2824	3503	811614.921	820003.336	銀樺	Grevillea robusta	120	2	5	*	FELL	FELL	
3503	T2825	3503	811610.414	820001.779	銀樺	Grevillea robusta	150	3	6	*	FELL	FELL	
3503	T2826	3503	811606.248	820001.058	銀樺	Grevillea robusta	120	2	6	*	FELL	FELL	
3503	T2827	3503	811608.124	820001.837	銀樺	Grevillea robusta	125	2	6	*	FELL	FELL	
3503	T2828	3503	811603.75	819999.498	銀樺	Grevillea robusta	110	3	5	*	FELL	FELL	
3503	T2829	3503	811601.142	819998.056	銀樺	Grevillea robusta	100	2	5	*	FELL	FELL	
3503	T2830	3503	811596.549	819997.142	銀樺	Grevillea robusta	150	3	6	*	FELL	FELL	
3503	T2831	3503	811595.146	819997.973	銀樺	Grevillea robusta	100	2	4	*	FELL	FELL	
3503	T2832	3503	811593.285	819995.994	銀樺	Grevillea robusta	130	2	3	*	FELL	FELL	
3503	T2833	3503	811591.649	819995.917	銀樺	Grevillea robusta	160	3	4	*	FELL	FELL	
3503	T2835	3503	811551.5261	819981.7465	銀樺	Grevillea robusta	145	3	6	FELL	FELL	FELL	
3503	T2836	3503	811555.75	819981.7259	銀樺	Grevillea robusta	135	3	5	FELL	FELL	FELL	
3503	T2837	3503	811530.2271	819973.1317	銀樺	Grevillea robusta	100	3	5	FELL	FELL	FELL	
3503	T2838	3503	811591.033	820015.0922	銀樺	Grevillea robusta	135	3	6	FELL	FELL	FELL	
3503	T2839	3503	811587.4376	820014.3732	紅膠木	Lophostemon confertus	190	8	7	FELL	FELL	FELL	
3503	T2883	3503	811530.4277	819965.4969	銀樺	Grevillea robusta	130	3	6	FELL	FELL	FELL	
3503	T2884	3503	811527.9982	819964.4492	銀樺	Grevillea robusta	140	3	6	FELL	FELL	FELL	
3503	T2914	3503	811467.2535	819924.1006	垂葉榕	Ficus benjamina	230	8	9	FELL	FELL	FELL	
3503	T2915	3503	811470.812	819923.8546	垂葉榕	Ficus benjamina	215	6	8	FELL	FELL	FELL	
3503	T2916	3503	811468.0169	819917.6263	垂葉榕	Ficus benjamina	225	6	7	FELL	FELL	FELL	
3503	T2917	3503	811458.8193	819899.6831	垂葉榕	Ficus benjamina	200	8	8	FELL	FELL	FELL	
3503	T2918	3503	811456.9986	819895.9072	垂葉榕	Ficus benjamina	260	8	9	FELL	FELL	FELL	
3503	T2919	3503	811462.0653	819895.1999	垂葉榕	Ficus benjamina	245	8	8	FELL	FELL	FELL	
3503	T2938	3503	811537.0355	819917.5632	垂葉榕	Ficus benjamina	225	8	8	FELL	FELL	FELL	
3503	T2939	3503	811537.8463	819915.4534	垂葉榕	Ficus benjamina	205	8	8	FELL	FELL	FELL	
3503	T2940	3503	811538.7845	819911.7577	垂葉榕	Ficus benjamina	165	4	8	FELL	FELL	FELL	
3503	T2941	3503	811539.5657	819908.1966	垂葉榕	Ficus benjamina	215	8	8	FELL	FELL	FELL	
3503	T2942	3503	811540.2171	819906.0237	垂葉榕	Ficus benjamina	130	2	5	FELL	FELL	FELL	
3503	T2943	3503	811541.6946	819902.593	垂葉榕	Ficus benjamina	230	8	7	FELL	FELL	FELL	
3503	T2944	3503	811534.5625	819901.4187	垂葉榕	Ficus benjamina	215	6	7	FELL	FELL	FELL	
3503	T2945	3503	811545.4702	819897.6905	苦楝	Melia azedarach	210	6	7	FELL	FELL	FELL	
3503	T2946	3503	811547.357	819898.4851	苦楝	Melia azedarach	140	6	7	FELL	FELL	FELL	
3503	T2950	3503	811571.0078	819862.0616	黃槿	Hibiscus tiliaceus	205	6	8	FELL	FELL	FELL	
3503	T2951	3503	811573.6261	819860.1849	黃槿	Hibiscus tiliaceus	285	6	8	FELL	FELL	FELL	
3503	T2952	3503	811577.0766	819858.264	黃槿	Hibiscus tiliaceus	255	8	8	FELL	FELL	FELL	
3503	T2953	3503	811580.874	819857.1261	黃槿	Hibiscus tiliaceus	225	7	8	FELL	FELL	FELL	
3503	T2954	3503	811584.1838	819857.5631	黃槿	Hibiscus tiliaceus	205	7	8	FELL	FELL	FELL	
3503	T2955	3503	811586.0076	819854.2774	黃槿	Hibiscus tiliaceus	225	8	8	FELL	FELL	FELL	
3503	T2956	3503	811589.2795	819855.0102	黃槿	Hibiscus tiliaceus	240	6	8	FELL	FELL	FELL	
3503	T2957	3503	811587.7548	819858.6342	黃槿	Hibiscus tiliaceus	230	6	7	FELL	FELL	FELL	
3503	T2958	3503	811590.8355	819859.6539	黃槿	Hibiscus tiliaceus	225	6	7	FELL	FELL	FELL	
3503	T2959	3503	811591.9372	819855.6997	黃槿	Hibiscus tiliaceus	215	6	8	FELL	FELL	FELL	
3503	T2960	3503	811595.0588	819856.5982	黃槿	Hibiscus tiliaceus	190	7	8	FELL	FELL	FELL	
3503	T2961	3503	811593.7039	819860.7705	黃槿	Hibiscus tiliaceus	260	8	8	FELL	FELL	FELL	
3503	T2962	3503	811597.3169	819861.8913	黃槿	Hibiscus tiliaceus	265	8	8	FELL	FELL	FELL	
3503	T2963	3503	811598.9118	819858.1086	黃槿	Hibiscus tiliaceus	300	8	8	FELL	FELL	FELL	
3503	T2964	3503	811601.96	819862.4595	黃槿	Hibiscus tiliaceus	285	8	8	FELL	FELL	FELL	
3503	T2965	3503	811605.1951	819864.3796	黃槿	Hibiscus tiliaceus	275	8	8	FELL	FELL	FELL	
3503	T2966	3503	811609.8764	819861.5876	黃槿	Hibiscus tiliaceus	265	7	8	FELL	FELL	FELL	
3503	T2967	3503	811758.7007	819662.7	垂葉榕	Ficus benjamina	155	4	6	FELL	FELL	FELL	
3503	T2968	3503	811776.8647	819623.9263	垂葉榕	Ficus benjamina	225	8	8	FELL	FELL	FELL	
3503	T2969	3503	811777.519	819622.6111	垂葉榕	Ficus benjamina	195	7	8	FELL	FELL	FELL	
3503	T2970	3503	811675.9677	819581.9765	垂葉榕	Ficus benjamina	205	6	9	FELL	FELL	FELL	
3503	T2971	3503	811674.3926	819575.3587	垂葉榕	Ficus benjamina	170	5	8	FELL	FELL	FELL	
3503	T2972	3503	811673.83	819571.3163	垂葉榕	Ficus benjamina	260	6	8	FELL	FELL	FELL	
3503	T2973	3503	811673.7105	819567.6357	垂葉榕	Ficus benjamina	215	7	8	FELL	FELL	FELL	
3503	T2974	3503	811673.3071	819563.5969	垂葉榕	Ficus benjamina	210	7	8	FELL	FELL	FELL	
3503	T2975	3503	811672.1035	819559.9442	垂葉榕	Ficus benjamina	215	7	8	FELL	FELL	FELL	
3503	T2976	3503	811672.2852	819556.2132	垂葉榕	Ficus benjamina	180	6	8	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3503	T2977	3503	811671.4024	819552.9569	垂葉榕	<i>Ficus benjamina</i>	195	7	8	FELL	FELL	FELL	
3503	T2978	3503	811671.0478	819549.3686	垂葉榕	<i>Ficus benjamina</i>	205	6	8	FELL	FELL	FELL	
3503	T2979	3503	811671.0063	819545.7492	垂葉榕	<i>Ficus benjamina</i>	225	7	8	FELL	FELL	FELL	
3503	T2980	3503	811670.7522	819541.1446	垂葉榕	<i>Ficus benjamina</i>	240	8	8	FELL	FELL	FELL	
3503	T2981	3503	811669.8359	819538.2594	垂葉榕	<i>Ficus benjamina</i>	160	5	8	FELL	FELL	FELL	
3503	T2982	3503	811666.841	819536.211	垂葉榕	<i>Ficus benjamina</i>	240	8	8	FELL	FELL	FELL	
3503	T2984	3503	811650.695	819558.8973	大花紫薇	<i>Lagerstroemia speciosa</i>	145	5	4	FELL	FELL	FELL	
3503	T2985	3503	811651.3961	819567.1367	大花紫薇	<i>Lagerstroemia speciosa</i>	125	4	4	FELL	FELL	FELL	
3503	T2986	3503	811643.298	819503.9816	垂葉榕	<i>Ficus benjamina</i>	225	6	8	FELL	FELL	FELL	
3503	T2987	3503	811643.6152	819501.4488	垂葉榕	<i>Ficus benjamina</i>	195	5	8	FELL	FELL	FELL	
3503	T2991	3503	811636.8564	819504.6597	垂葉榕	<i>Ficus benjamina</i>	195	7	8	FELL	FELL	FELL	
3503	T2992	3503	811663.42	819511.0293	垂葉榕	<i>Ficus benjamina</i>	205	7	8	FELL	FELL	FELL	
3503	T2993	3503	811663.0745	819507.9529	垂葉榕	<i>Ficus benjamina</i>	170	6	7	FELL	FELL	FELL	
3503	T2994	3503	811663.4943	819502.1075	垂葉榕	<i>Ficus benjamina</i>	210	6	7	FELL	FELL	FELL	
3503	T2995	3503	811663.799	819498.4195	垂葉榕	<i>Ficus benjamina</i>	180	6	7	FELL	FELL	FELL	
3503	T2996	3503	811666.3258	819491.4093	垂葉榕	<i>Ficus benjamina</i>	110	2	5	FELL	FELL	FELL	
3503	T2997	3503	811668.146	819488.1384	垂葉榕	<i>Ficus benjamina</i>	120	3	5	FELL	FELL	FELL	
3503	T2998	3503	811671.1243	819485.7112	垂葉榕	<i>Ficus benjamina</i>	110	2	5	FELL	FELL	FELL	
3503	T3001	3503	811668.9877	819478.4861	鐵刀木	<i>Senna siamea</i>	220	6	10	FELL	FELL	FELL	
3503	T3002	3503	811671.8945	819481.3156	鐵刀木	<i>Senna siamea</i>	125	4	7	FELL	FELL	FELL	
3503	T3003	3503	811673.8026	819482.5442	垂葉榕	<i>Ficus benjamina</i>	110	3	6	FELL	FELL	FELL	
3503	T3004	3503	811675.7389	819483.6615	垂葉榕	<i>Ficus benjamina</i>	125	3	6	FELL	FELL	FELL	
3503	T3005	3503	811677.7225	819482.8662	垂葉榕	<i>Ficus benjamina</i>	95	3	5	FELL	FELL	FELL	
3503	T3006	3503	811680.0778	819482.066	垂葉榕	<i>Ficus benjamina</i>	120	4	6	FELL	FELL	FELL	
3503	T3007	3503	811682.7056	819480.8761	垂葉榕	<i>Ficus benjamina</i>	185	5	7	FELL	FELL	FELL	
3503	T3008	3503	811686.6082	819480.8518	垂葉榕	<i>Ficus benjamina</i>	170	6	8	FELL	FELL	FELL	
3503	T3009	3503	811689.7741	819479.7525	垂葉榕	<i>Ficus benjamina</i>	200	5	7	FELL	FELL	FELL	
3503	T3011	3503	811678.0046	819478.3947	鐵刀木	<i>Senna siamea</i>	155	7	10	FELL	FELL	FELL	
3503	T3012	3503	811713.0237	819468.8084	銀樺	<i>Grevillea robusta</i>	110	3	4	FELL	FELL	FELL	
3503	T3013	3503	811723.7036	819472.9494	鐵刀木	<i>Senna siamea</i>	120	4	5	FELL	FELL	FELL	
3503	T3014	3503	811728.9686	819474.3808	鐵刀木	<i>Senna siamea</i>	110	6	7	FELL	FELL	FELL	
3503	T3025	3503	811773.4733	819481.227	鐵刀木	<i>Senna siamea</i>	140	6	7	FELL	FELL	FELL	
3503	T3026	3503	811775.2586	819482.4594	鐵刀木	<i>Senna siamea</i>	180	7	7	FELL	FELL	FELL	
3503	T3027	3503	811777.4513	819482.3962	紅膠木	<i>Lophostemon confertus</i>	125	5	7	FELL	FELL	FELL	
3503	T3029	3503	811811.2023	819502.8837	鐵刀木	<i>Senna siamea</i>	215	7	8	FELL	FELL	FELL	
3503	T3030	3508	811607.241	819475.165	鐵刀木	<i>Senna siamea</i>	215	5	9	RETAIN	FELL	FELL	
3503	T3030A	3508	811614.052	819464.003	鐵刀木	<i>Senna siamea</i>	180	5	9	FELL	FELL	FELL	
3503	T3189	3508	811710.587	819398.281	鐵刀木	<i>Senna siamea</i>	155	6	10	RETAIN	FELL	FELL	
3503	T3190	3503	811713.0888	819417.0996	鐵刀木	<i>Senna siamea</i>	210	8	15	FELL	FELL	FELL	
3503	T3191	3508	811708.031	819411.045	銀樺	<i>Grevillea robusta</i>	120	4	6	RETAIN	FELL	FELL	
3503	T3193	3503	811702.0131	819412.2825	銀樺	GREVILLEA ROBUSTA	155	5	9	FELL	FELL	FELL	
3503	T3194	3508	811699.116	819414.699	銀樺	<i>Grevillea robusta</i>	130	4	6	RETAIN	FELL	FELL	
3503	T3196	3503	811702.0285	819419.7629	鐵刀木	<i>Senna siamea</i>	165	6	12	FELL	FELL	FELL	
3503	T3227	3503	811700.935	819447.6326	紅膠木	<i>Lophostemon confertus</i>	125	3	5	FELL	FELL	FELL	
3503	T562	3503	811881.6266	819763.8929	耳果相思	<i>Acacia auriculiformis</i>	300	6	10	FELL	FELL	FELL	
3503	T563	3503	811881.7689	819753.8192	耳果相思	<i>Acacia auriculiformis</i>	240	6	10	FELL	FELL	FELL	
3503	T564	3503	811889.3323	819739.9014	台灣相思	<i>Acacia confusa</i>	300	8	8	FELL	FELL	FELL	
3503	T565	3503	811885.6822	819735.3161	耳果相思	<i>Acacia auriculiformis</i>	240	6	8	FELL	FELL	FELL	
3503	T566	3503	811893.1562	819733.4543	耳果相思	<i>Acacia auriculiformis</i>	310	7	10	FELL	FELL	FELL	
3503	T568	3503	811899.3509	819709.3941	銀合歡	<i>Leucaena leucocephala</i>	325	8	8	FELL	FELL	FELL	
3503	T569	3503	811900.9756	819699.3232	銀合歡	<i>Leucaena leucocephala</i>	300	8	8	FELL	FELL	FELL	
3503	T636	3503	811762.2942	819891.578	銀樺	<i>Grevillea robusta</i>	115	4	8	FELL	FELL	FELL	
3503	T637	3503	811763.2402	819888.8642	銀樺	<i>Grevillea robusta</i>	135	4	8	FELL	FELL	FELL	
3503	T638	3503	811764.0844	819886.4193	銀樺	<i>Grevillea robusta</i>	145	4	8	FELL	FELL	FELL	
3503	T639	3503	811765.1834	819883.9324	銀樺	<i>Grevillea robusta</i>	140	4	10	FELL	FELL	FELL	
3503	T640	3503	811767.1844	819879.9601	鐵刀木	<i>Senna siamea</i>	260	9	10	FELL	FELL	FELL	
3503	T641	3503	811768.0325	819878.0379	銀樺	<i>Grevillea robusta</i>	115	3	7	FELL	FELL	FELL	
3503	T642	3503	811770.3142	819872.9406	銀樺	<i>Grevillea robusta</i>	145	4	8	FELL	FELL	FELL	
3503	T643	3503	811770.9152	819870.4573	銀樺	<i>Grevillea robusta</i>	125	4	8	FELL	FELL	FELL	
3503	T644	3503	811770.7072	819868.5772	鐵刀木	<i>Senna siamea</i>	210	6	9	FELL	FELL	FELL	
3503	T645	3503	811772.704	819866.9045	銀樺	<i>Grevillea robusta</i>	190	5	8	FELL	FELL	FELL	
3503	T646	3503	811774.0805	819863.5729	鐵刀木	<i>Senna siamea</i>	190	6	6	FELL	FELL	FELL	
3503	T647	3503	811772.9364	819861.1877	銀樺	<i>Grevillea robusta</i>	105	2	4	FELL	FELL	FELL	
3503	T648	3503	811777.0587	819854.2343	鐵刀木	<i>Senna siamea</i>	245	7	10	FELL	FELL	FELL	
3503	T649	3503	811778.4854	819851.921	鐵刀木	<i>Senna siamea</i>	260	7	9	FELL	FELL	FELL	
3503	T650	3503	811779.3136	819846.9965	鐵刀木	<i>Senna siamea</i>	250	6	8	FELL	FELL	FELL	
3503	T651	3503	811779.9751	819841.4906	銀樺	<i>Grevillea robusta</i>	210	4	9	FELL	FELL	FELL	
3503	T652	3503	811782.5554	819840.4916	銀樺	<i>Grevillea robusta</i>	175	5	10	FELL	FELL	FELL	
3503	T653	3503	811781.9413	819837.0654	鐵刀木	<i>Senna siamea</i>	215	8	9	FELL	FELL	FELL	
3503	T654	3503	811784.0636	819835.1722	鐵刀木	<i>Senna siamea</i>	190	6	8	FELL	FELL	FELL	
3503	T656	3503	811784.956	819828.7968	銀樺	<i>Grevillea robusta</i>	160	3	8	FELL	FELL	FELL	
3503	T657	3503	811786.4555	819828.9715	銀樺	<i>Grevillea robusta</i>	190	4	9	FELL	FELL	FELL	
3503	T665	3503	811828.0763	819701.2597	銀樺	<i>Grevillea robusta</i>	110	2	6	FELL	FELL	FELL	
3503	T666	3503	811826.0731	819694.1514	銀樺	<i>Grevillea robusta</i>	105	3	7	FELL	FELL	FELL	
3503	T667	3503	811827.2089	819690.4866	銀樺	<i>Grevillea robusta</i>	145	3	7	FELL	FELL	FELL	
3503	T668	3503	811831.7269	819679.09	銀樺	<i>Grevillea robusta</i>	110	3	6	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3503	T669	3503	811834.439	819664.3402	銀樟	<i>Grevillea robusta</i>	110	4	7	FELL	FELL	FELL	
3503	T670	3503	811836.7472	819658.5941	銀樟	<i>Grevillea robusta</i>	200	4	10	FELL	FELL	FELL	
3503	T671	3503	811837.3882	819653.0066	銀樟	<i>Grevillea robusta</i>	145	5	7	FELL	FELL	FELL	
3503	T672	3503	811837.567	819648.2486	銀樟	<i>Grevillea robusta</i>	180	4	7	FELL	FELL	FELL	
3503	T675	3503	811817.0486	819730.4167	鐵刀木	<i>Senna siamea</i>	100	3	7	FELL	FELL	FELL	
3503	T677	3503	811818.829	819725.7787	鐵刀木	<i>Senna siamea</i>	180	5	7	FELL	FELL	FELL	
3503	T678	3503	811821.1564	819704.7097	黃槿	<i>Hibiscus tiliaceus</i>	205	5	5	FELL	FELL	FELL	
3503	T679	3503	811822.2785	819700.2688	黃槿	<i>Hibiscus tiliaceus</i>	110	3	4	FELL	FELL	FELL	
3503	T680	3503	811820.2073	819698.0592	黃槿	<i>Hibiscus tiliaceus</i>	95	2	3	FELL	FELL	FELL	
3503	T681	3503	811817.9536	819696.8511	黃槿	<i>Hibiscus tiliaceus</i>	130	3	4	FELL	FELL	FELL	
3503	T682	3503	811823.4308	819696.916	黃槿	<i>Hibiscus tiliaceus</i>	120	4	4	FELL	FELL	FELL	
3503	T683	3503	811826.3931	819686.7894	黃槿	<i>Hibiscus tiliaceus</i>	160	5	6	FELL	FELL	FELL	
3503	T684	3503	811825.1633	819676.7568	黃槿	<i>Hibiscus tiliaceus</i>	165	5	5	FELL	FELL	FELL	
3503	T689	3503	811833.7284	819653.4138	銀樟	<i>Grevillea robusta</i>	140	3	9	FELL	FELL	FELL	
3503	T690	3503	811836.5697	819647.4155	銀樟	<i>Grevillea robusta</i>	130	3	6	FELL	FELL	FELL	
3503	T691	3503	811836.892	819640.758	銀樟	<i>Grevillea robusta</i>	195	4	9	FELL	FELL	FELL	
3503	T692	3503	811836.5158	819614.4323	垂葉榕	<i>Ficus benjamina</i>	205	6	7	FELL	FELL	FELL	
3503	T693	3503	811833.9809	819613.4796	垂葉榕	<i>Ficus benjamina</i>	205	6	7	FELL	FELL	FELL	
3503	T694	3503	811831.9495	819612.7264	垂葉榕	<i>Ficus benjamina</i>	255	6	7	FELL	FELL	FELL	
3503	T695	3503	811833.8823	819607.2979	垂葉榕	<i>Ficus benjamina</i>	165	4	6	FELL	FELL	FELL	
3503	T696	3503	811835.9394	819608.1413	垂葉榕	<i>Ficus benjamina</i>	200	4	6	FELL	FELL	FELL	
3503	T697	3503	811839.0658	819609.2891	垂葉榕	<i>Ficus benjamina</i>	190	4	6	FELL	FELL	FELL	
3503	T698	3503	811840.7643	819602.4292	垂葉榕	<i>Ficus benjamina</i>	215	5	7	FELL	FELL	FELL	
3503	T699	3503	811838.4668	819601.5919	垂葉榕	<i>Ficus benjamina</i>	190	5	7	FELL	FELL	FELL	
3503	T700	3503	811835.9245	819600.5875	垂葉榕	<i>Ficus benjamina</i>	250	6	7	FELL	FELL	FELL	
3503	T701	3503	811839.9549	819596.8615	垂葉榕	<i>Ficus benjamina</i>	210	5	7	FELL	FELL	FELL	
3503	T702	3503	811842.1469	819594.7435	耳果相思	<i>Acacia auriculiformis</i>	290	6	10	FELL	FELL	FELL	
3503	T703	3503	811837.4088	819593.5575	垂葉榕	<i>Ficus benjamina</i>	235	7	7	FELL	FELL	FELL	
3503	T704	3503	811839.2185	819585.8756	垂葉榕	<i>Ficus benjamina</i>	265	8	9	FELL	FELL	FELL	
3503	T705	3503	811831.801	819548.2848	垂葉榕	<i>Ficus benjamina</i>	155	5	7	FELL	FELL	FELL	
3503	T706	3503	811832.4036	819547.1106	耳果相思	<i>Acacia auriculiformis</i>	125	3	9	FELL	FELL	FELL	
3503	T707	3503	811832.2062	819545.9792	耳果相思	<i>Acacia auriculiformis</i>	140	3	9	FELL	FELL	FELL	
3503	T708	3503	811831.5541	819545.6695	耳果相思	<i>Acacia auriculiformis</i>	235	5	9	FELL	FELL	FELL	
3503	T709	3503	811828.4242	819547.4772	垂葉榕	<i>Ficus benjamina</i>	190	6	7	FELL	FELL	FELL	
3503	T710	3503	811825.1637	819546.3268	垂葉榕	<i>Ficus benjamina</i>	140	4	7	FELL	FELL	FELL	
3503	T711	3503	811822.4641	819545.9012	垂葉榕	<i>Ficus benjamina</i>	170	4	7	FELL	FELL	FELL	
3503	T712	3503	811820.048	819544.9957	垂葉榕	<i>Ficus benjamina</i>	190	6	7	FELL	FELL	FELL	
3503	T713	3503	811821.5465	819538.1386	垂葉榕	<i>Ficus benjamina</i>	180	4	5	FELL	FELL	FELL	
3503	T714	3503	811825.1873	819539.5038	垂葉榕	<i>Ficus benjamina</i>	150	5	6	FELL	FELL	FELL	
3503	T715	3503	811828.6209	819540.8304	垂葉榕	<i>Ficus benjamina</i>	110	3	5	FELL	FELL	FELL	
3503	T718	3503	811829.6561	819538.1053	耳果相思	<i>Acacia auriculiformis</i>	175	6	10	FELL	FELL	FELL	
3503	T719	3503	811829.2841	819537.079	耳果相思	<i>Acacia auriculiformis</i>	190	4	8	FELL	FELL	FELL	
3503	T720	3503	811827.7935	819532.9051	耳果相思	<i>Acacia auriculiformis</i>	295	5	11	FELL	FELL	FELL	
3503	T721	3503	811824.9833	819531.1756	垂葉榕	<i>Ficus benjamina</i>	250	6	9	FELL	FELL	FELL	
3503	T722	3503	811826.3862	819528.8965	耳果相思	<i>Acacia auriculiformis</i>	170	4	10	FELL	FELL	FELL	
3503	T723	3503	811825.0296	819526.0719	耳果相思	<i>Acacia auriculiformis</i>	270	4	10	FELL	FELL	FELL	
3503	T741	3503	811863.281	819624.893	宮粉羊蹄甲	<i>Bauhinia variegata</i>	180	5	6	FELL	FELL	FELL	
3503	T742	3503	811863.8422	819621.1064	宮粉羊蹄甲	<i>Bauhinia variegata</i>	145	4	5	FELL	FELL	FELL	
3503	T743	3503	811864.0362	819616.2237	宮粉羊蹄甲	<i>Bauhinia variegata</i>	180	4	5	FELL	FELL	FELL	
3503	T744	3503	811864.2603	819613.8466	濕地松	<i>Pinus elliptii</i>	120	2	6	FELL	FELL	FELL	
3503	T745	3503	811864.3107	819612.2685	濕地松	<i>Pinus elliptii</i>	110	3	5	FELL	FELL	FELL	
3503	T746	3503	811864.5279	819608.6838	濕地松	<i>Pinus elliptii</i>	120	2	5	FELL	FELL	FELL	
3503	T747	3503	811866.3477	819600.0625	耳果相思	<i>Acacia auriculiformis</i>	340	6	9	FELL	FELL	FELL	
3503	T751	3503	811885.3647	819613.0168	台灣相思	<i>Acacia confusa</i>	170	5	9	FELL	FELL	FELL	
3503	T752	3503	811885.7403	819611.96	台灣相思	<i>Acacia confusa</i>	185	5	9	FELL	FELL	FELL	
3503	T753	3503	811886.3905	819612.5858	台灣相思	<i>Acacia confusa</i>	145	3	7	FELL	FELL	FELL	
3503	T754	3503	811886.5755	819610.5082	台灣相思	<i>Acacia confusa</i>	190	4	8	FELL	FELL	FELL	
3503	T755	3503	811885.4178	819613.7529	台灣相思	<i>Acacia confusa</i>	100	3	8	FELL	FELL	FELL	
3503	T756	3503	811886.2295	819614.2155	台灣相思	<i>Acacia confusa</i>	95	2	7	FELL	FELL	FELL	
3503	T757	3503	811884.5501	819614.9549	台灣相思	<i>Acacia confusa</i>	135	3	9	FELL	FELL	FELL	
3503	T758	3503	811885.1692	819616.4815	台灣相思	<i>Acacia confusa</i>	110	3	8	FELL	FELL	FELL	
3503	T759	3503	811885.9032	819616.1757	台灣相思	<i>Acacia confusa</i>	105	2	6	FELL	FELL	FELL	
3503	T760	3503	811885.8479	819617.1665	台灣相思	<i>Acacia confusa</i>	100	1	5	FELL	FELL	FELL	
3503	T761	3503	811885.6758	819618.0693	台灣相思	<i>Acacia confusa</i>	165	5	8	FELL	FELL	FELL	
3503	T762	3503	811884.4044	819620.962	台灣相思	<i>Acacia confusa</i>	165	4	8	FELL	FELL	FELL	
3503	T763	3503	811884.975	819621.6593	台灣相思	<i>Acacia confusa</i>	135	3	7	FELL	FELL	FELL	
3503	T764	3503	811884.8794	819622.6219	台灣相思	<i>Acacia confusa</i>	100	2	6	FELL	FELL	FELL	
3503	T765	3503	811883.1193	819623.1704	台灣相思	<i>Acacia confusa</i>	160	5	9	FELL	FELL	FELL	
3503	T766	3503	811883.1991	819622.2865	台灣相思	<i>Acacia confusa</i>	105	3	9	FELL	FELL	FELL	
3503	T767	3503	811884.2291	819622.0277	台灣相思	<i>Acacia confusa</i>	145	4	9	FELL	FELL	FELL	
3503	T768	3503	811882.1484	819616.1089	耳果相思	<i>Acacia auriculiformis</i>	265	6	10	FELL	FELL	FELL	
3503	T769	3503	811880.4934	819624.2423	耳果相思	<i>Acacia auriculiformis</i>	250	7	10	FELL	FELL	FELL	
3503	T770	3503	811881.8289	819630.2467	黃花夾竹桃	<i>Thevetia peruviana</i>	130	4	4	FELL	FELL	FELL	
3503	T771	3503	811879.2905	819632.1584	黃花夾竹桃	<i>Thevetia peruviana</i>	135	5	5	FELL	FELL	FELL	
3503	T772	3503	811878.9684	819631.6994	耳果相思	<i>Acacia auriculiformis</i>	220	5	10	FELL	FELL	FELL	
3503	T773	3503	811882.0702	819635.0853	黃花夾竹桃	<i>Thevetia peruviana</i>	125	5	4	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3503	T774	3503	811880.297	819638.9309	黃花夾竹桃	<i>Thevetia peruviana</i>	240	7	5	FELL	FELL	FELL	
3503	T775	3503	811877.0709	819639.6152	耳果相思	<i>Acacia auriculiformis</i>	310	9	11	FELL	FELL	FELL	
3503	T776	3503	811875.0276	819647.2709	大葉相思	<i>Acacia mangium</i>	390	8	10	FELL	FELL	FELL	
3503	T789	3503	811841.273	819641.8088	銀樺	<i>Grevillea robusta</i>	100	3	5	FELL	FELL	FELL	
3503	T790	3503	811842.2498	819632.8738	銀樺	<i>Grevillea robusta</i>	205	4	10	FELL	FELL	FELL	
3503	T791	3503	811842.2014	819628.5416	耳果相思	<i>Acacia auriculiformis</i>	205	4	9	FELL	FELL	FELL	
3503	T792	3503	811843.4386	819623.8498	銀樺	<i>Grevillea robusta</i>	200	5	9	FELL	FELL	FELL	
3503	T793	3503	811842.3108	819628.8753	銀樺	<i>Grevillea robusta</i>	115	3	8	FELL	FELL	FELL	
3503	T794	3503	811843.1885	819618.5265	銀樺	<i>Grevillea robusta</i>	100	2	7	FELL	FELL	FELL	
3503	T795	3503	811843.6596	819612.4284	銀樺	<i>Grevillea robusta</i>	145	4	9	FELL	FELL	FELL	
3503	T796	3503	811843.6666	819599.8194	銀樺	<i>Grevillea robusta</i>	100	2	6	FELL	FELL	FELL	
3503	T797	3503	811843.2603	819594.2444	銀樺	<i>Grevillea robusta</i>	100	2	6	FELL	FELL	FELL	
3503	T798	3503	811843.5965	819588.8107	銀樺	<i>Grevillea robusta</i>	165	3	9	FELL	FELL	FELL	
3503	T799	3503	811843.3053	819585.8036	銀樺	<i>Grevillea robusta</i>	115	2	8	FELL	FELL	FELL	
3503	T800	3503	811841.5196	819575.2359	銀樺	<i>Grevillea robusta</i>	145	3	8	FELL	FELL	FELL	
3503	T801	3503	811840.51	819569.2426	銀樺	<i>Grevillea robusta</i>	160	4	9	FELL	FELL	FELL	
3503	T802	3503	811838.6529	819567.721	銀樺	<i>Grevillea robusta</i>	125	3	7	FELL	FELL	FELL	
3503	T803	3503	811839.4151	819563.2405	銀樺	GREVILLEA ROBUSTA	170	3	7	FELL	FELL	FELL	
3503	T805	3503	811835.3023	819550.8619	鐵刀木	<i>Senna siamea</i>	260	6	9	FELL	FELL	FELL	
3503	T806	3503	811834.0203	819547.1969	鐵刀木	<i>Senna siamea</i>	170	5	8	FELL	FELL	FELL	
3503	T807	3503	811832.9753	819543.6504	鐵刀木	<i>Senna siamea</i>	160	5	7	FELL	FELL	FELL	
3503	T808	3503	811828.865	819534.9118	銀樺	<i>Grevillea robusta</i>	140	6	12	FELL	FELL	FELL	
3503	T809	3503	811827.273	819526.0796	鐵刀木	<i>Senna siamea</i>	145	4	6	FELL	FELL	FELL	
3503	T810	3503	811825.3367	819522.3289	鐵刀木	<i>Senna siamea</i>	125	3	6	FELL	FELL	FELL	
3503	T812	3503	811844.476	819472.355	細葉榕	<i>Ficus microcarpa</i>	465	8	14	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3503	T813	3508	811843.473	819476.373	細葉榕	<i>Ficus microcarpa</i>	540	12	14	RETAIN	RETAIN	Excluded from the Project	Handed over to AAHK in Aug 2025.
3503	T814	3503	811848.091	819476.008	細葉榕	<i>Ficus microcarpa</i>	435	8	14	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3503	T815	3503	811847.561	819480.942	細葉榕	<i>Ficus microcarpa</i>	475	8	14	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3503	T816	3503	811851.615	819479.6995	細葉榕	<i>Ficus microcarpa</i>	370	8	14	FELL	FELL	FELL	
3503	T817	3503	811852.4927	819483.8324	細葉榕	<i>Ficus microcarpa</i>	446	12	12	FELL	FELL	FELL	
3503	T818	3503	811857.692	819472.1271	細葉榕	<i>Ficus microcarpa</i>	1000	12	12	FELL	FELL	FELL	
3503	T819	3503	811867.3128	819477.67	細葉榕	<i>Ficus microcarpa</i>	730	12	14	FELL	FELL	FELL	
3503	T820	3503	811865.755	819467.469	鳳凰木	<i>Delonix regia</i>	300	7	9	FELL	FELL	FELL	
3503	T821	3503	811873.354	819471.072	鳳凰木	<i>Delonix regia</i>	340	6	7	FELL	FELL	FELL	
3503	T824	3503	811871.6048	819451.0912	細葉榕	<i>Ficus microcarpa</i>	1000	12	12	FELL	FELL	FELL	
3503	T825	3503	811862.967	819445.3242	細葉榕	<i>Ficus microcarpa</i>	950	10	12	FELL	FELL	FELL	
3503	T827	3503	811852.5277	819447.9131	細葉榕	<i>Ficus microcarpa</i>	900	12	10	FELL	FELL	FELL	
3503	T828	3503	811840.1687	819448.4583	細葉榕	<i>Ficus microcarpa</i>	450	12	10	FELL	FELL	FELL	
3503	T829	AAHK	811834.950	819450.478	細葉榕	<i>Ficus microcarpa</i>	450	10	12	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3503	T830	AAHK	811837.974	819454.637	細葉榕	<i>Ficus microcarpa</i>	425	8	12	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3503	T831	AAHK	811833.979	819457.520	細葉榕	<i>Ficus microcarpa</i>	385	8	12	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3503	T832	3503	811837.5654	819459.683	細葉榕	<i>Ficus microcarpa</i>	450	12	12	FELL	FELL	FELL	
3503	T833	3508	811834.113	819463.663	細葉榕	<i>Ficus microcarpa</i>	550	10	12	RETAIN	RETAIN	Excluded from the Project	Handed over to AAHK in Aug 2025.
3503	T834	3508	811841.579	819461.552	羅漢松	<i>Podocarpus macrophyllus</i>	310	4	6	RETAIN	RETAIN	Excluded from the Project	Handed over to AAHK in Aug 2025.
3503	T835	AAHK	811844.795	819460.472	羅漢松	<i>Podocarpus macrophyllus</i>	135	3	4	TRANSPLANT	TRANSPLANTED and REMOVED eventually	TRANSPLANTED and REMOVED eventually	Removed by other party due to conflict with works in 2023 (Feb 2024).
3503	T836	AAHK	811846.862	819461.371	羅漢松	<i>Podocarpus macrophyllus</i>	100	2	4	TRANSPLANT	TRANSPLANTED and REMOVED eventually	TRANSPLANTED and REMOVED eventually	Removed by other party due to conflict with works in 2023 (Feb 2024).
3503	T837	3503	811850.223	819459.190	羅漢松	<i>Podocarpus macrophyllus</i>	150	3	6	FELL	FELL	FELL	
3503	T838	AAHK	811847.6852	819459.637	羅漢松	<i>Podocarpus macrophyllus</i>	100	2	5	TRANSPLANT	TRANSPLANTED and REMOVED eventually	TRANSPLANTED and REMOVED eventually	Removed by other party due to conflict with works in 2023 (Feb 2024).
3508	A1	3508	812011.519	819369.687	旅人蕉	<i>Ravenala madagascariensis</i>	215	5	6	*	FELL	FELL	
3508	A142	3508	811707.362	819394.046	銀合歡	<i>Leucaena leucocephala</i>	136	6	4	*	FELL	FELL	
3508	A143	3508	819391.345	811700.914	銀合歡	<i>Leucaena leucocephala</i>	127	6	3	*	FELL	FELL	
3508	A144	3508	811696.836	819406.606	黃槿	<i>Hibiscus tiliaceus</i>	300	4	5	*	FELL	FELL	
3508	A145	3508	811693.172	819405.948	潺槁樹	<i>Litsea glutinosa</i>	98	5	3	*	FELL	FELL	
3508	A146	3508	811703.342	819397.118	紅膠木	<i>Lophostemon confertus</i>	103	6	3	*	FELL	FELL	
3508	A147	3508	811698.518	819398.269	台灣相思	<i>Acacia confusa</i>	185	6	5	*	FELL	FELL	
3508	A148	3508	811695.524	819399.11	潺槁樹	<i>Litsea glutinosa</i>	99	6	4	*	FELL	FELL	
3508	A149	3508	811716.23	819383.221	宮粉羊蹄甲	<i>Bauhinia variegata</i>	157	6	4	*	FELL	FELL	
3508	A150	3508	811717.379	81999378.56	潺槁樹	<i>Litsea glutinosa</i>	100	6	3	*	FELL	FELL	
3508	A151	3508	811724.258	819374.112	洋紫荊	<i>Bauhinia x blakeana</i>	98	5	3	*	FELL	FELL	
3508	A2	3508	812014.845	879315.476	椰子	<i>Cocos nucifera</i>	282	4	7	*	RETAIN	RETAIN	
3508	T1236	3508	811951.432	819465.22	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	REMOVED	REMOVED	
3508	T1237	3508	811950.932	819466.17	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1238	3508	811950.258	819465.774	旅人蕉	<i>Ravenala madagascariensis</i>	210	2	5	RETAIN	REMOVED	REMOVED	
3508	T1239	3508	811949.186	819464.353	旅人蕉	<i>Ravenala madagascariensis</i>	205	2	4	RETAIN	REMOVED	REMOVED	
3508	T1240	3508	811950.534	819463.95	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1241	3508	811951.337	819464.358	旅人蕉	<i>Ravenala madagascariensis</i>	270	2	5	RETAIN	REMOVED	REMOVED	
3508	T1244	3508	811949.156	819462.48	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1245	3508	811948.447	819462.922	旅人蕉	<i>Ravenala madagascariensis</i>	290	2	5	RETAIN	REMOVED	REMOVED	
3508	T1246	3508	811948.085	819463.697	旅人蕉	<i>Ravenala madagascariensis</i>	210	2	5	RETAIN	REMOVED	REMOVED	
3508	T1248	3508	811946.05	819464.03	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1249	3508	811945.355	819463.638	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	4	RETAIN	REMOVED	REMOVED	
3508	T1261	3508	811937.418	819455.235	旅人蕉	<i>Ravenala madagascariensis</i>	210	2	5	RETAIN	REMOVED	REMOVED	
3508	T1262	3508	811937.655	819457.269	旅人蕉	<i>Ravenala madagascariensis</i>	215	2	5	RETAIN	REMOVED	REMOVED	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T1263	3508	811938.507	819456.742	旅人蕉	<i>Ravenala madagascariensis</i>	190	2	5	RETAIN	REMOVED	REMOVED	
3508	T1264	3508	811938.728	819455.422	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	REMOVED	REMOVED	
3508	T1265	3508	811939.361	819456.368	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	4	RETAIN	REMOVED	REMOVED	
3508	T1267	3508	811940.256	819457.636	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	REMOVED	REMOVED	
3508	T1268	3508	811941.614	819458.577	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1269	3508	811943.616	819460.29	旅人蕉	<i>Ravenala madagascariensis</i>	330	2	5	RETAIN	REMOVED	REMOVED	
3508	T1270	3508	811945.717	819461.351	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1270B	3508	811947.14	819456.731	菩提	<i>Melia azedarach</i>	234	2	8	*	REMOVED	REMOVED	Duplicated
3508	T1271	3508	811945.432	819462.478	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1272	3508	811944.617	819462.221	旅人蕉	<i>Ravenala madagascariensis</i>	290	2	5	RETAIN	REMOVED	REMOVED	
3508	T1273	3508	811943.837	819461.793	旅人蕉	<i>Ravenala madagascariensis</i>	290	2	5	RETAIN	REMOVED	REMOVED	
3508	T1274	3508	811942.187	819460.257	旅人蕉	<i>Ravenala madagascariensis</i>	215	2	5	RETAIN	REMOVED	REMOVED	
3508	T1275	3508	811941.574	819459.926	旅人蕉	<i>Ravenala madagascariensis</i>	290	2	5	RETAIN	REMOVED	REMOVED	
3508	T1276	3508	811941.009	819459.48	旅人蕉	<i>Ravenala madagascariensis</i>	140	2	4	RETAIN	MISSING	MISSING	
3508	T1277	3508	811940.2881	819458.8344	旅人蕉	<i>Ravenala madagascariensis</i>	245	2	5	RETAIN	REMOVED	REMOVED	
3508	T1279	3508	811939.4901	819458.4649	旅人蕉	<i>Ravenala madagascariensis</i>	230	2	5	RETAIN	REMOVED	REMOVED	
3508	T1282	3508	811934.699	819452.582	旅人蕉	<i>Ravenala madagascariensis</i>	260	2	5	RETAIN	REMOVED	REMOVED	
3508	T1283	3508	811934.555	819451.536	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	4	RETAIN	REMOVED	REMOVED	
3508	T1284	3508	811932.968	819451.255	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1285	3508	811932.277	819450.194	旅人蕉	<i>Ravenala madagascariensis</i>	175	2	4	RETAIN	REMOVED	REMOVED	
3508	T1286	3508	811931.796	819449.509	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1287	3508	811931.117	819448.93	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	4	RETAIN	REMOVED	REMOVED	
3508	T1288	3508	811930.867	819448.151	旅人蕉	<i>Ravenala madagascariensis</i>	190	2	4	RETAIN	REMOVED	REMOVED	
3508	T1289	3508	811929.999	819446.7	旅人蕉	<i>Ravenala madagascariensis</i>	260	2	5	RETAIN	REMOVED	REMOVED	
3508	T1290	3508	811929.496	819445.855	旅人蕉	<i>Ravenala madagascariensis</i>	180	2	5	RETAIN	MISSING	MISSING	
3508	T1291	3508	811929.157	819445.115	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1292	3508	811928.624	819444.401	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	REMOVED	REMOVED	
3508	T1293	3508	811928.242	819442.335	旅人蕉	<i>Ravenala madagascariensis</i>	320	2	5	RETAIN	REMOVED	REMOVED	
3508	T1294	3508	811928.566	819441.163	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1296	3508	811927.611	819439.632	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	REMOVED	REMOVED	
3508	T1297	3508	811926.955	819439.904	旅人蕉	<i>Ravenala madagascariensis</i>	230	2	5	RETAIN	REMOVED	REMOVED	
3508	T1298	3508	811925.706	819440.422	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	REMOVED	REMOVED	
3508	T1299	3508	811924.824	819438.608	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	REMOVED	REMOVED	
3508	T1300	3508	811924.499	819437.856	旅人蕉	<i>Ravenala madagascariensis</i>	165	2	4	RETAIN	REMOVED	REMOVED	
3508	T1301	3508	811924.138	819437.015	旅人蕉	<i>Ravenala madagascariensis</i>	210	2	5	RETAIN	REMOVED	REMOVED	
3508	T1302	3508	811924.243	819435.803	旅人蕉	<i>Ravenala madagascariensis</i>	215	3	6	RETAIN	REMOVED	REMOVED	
3508	T1303	3508	811924.1	819435.069	旅人蕉	<i>Ravenala madagascariensis</i>	265	3	6	RETAIN	REMOVED	REMOVED	
3508	T1304	3508	811924.619	819434.669	旅人蕉	<i>Ravenala madagascariensis</i>	320	3	6	RETAIN	REMOVED	REMOVED	
3508	T1305	3508	811925.219	819435.261	旅人蕉	<i>Ravenala madagascariensis</i>	215	2	5	RETAIN	REMOVED	REMOVED	
3508	T1306	3508	811926.558	819435.816	旅人蕉	<i>Ravenala madagascariensis</i>	215	2	5	RETAIN	REMOVED	REMOVED	
3508	T1307	3508	811927.571	819437.299	旅人蕉	<i>Ravenala madagascariensis</i>	260	3	6	RETAIN	REMOVED	REMOVED	
3508	T1308	3508	811926.073	819436.95	旅人蕉	<i>Ravenala madagascariensis</i>	300	3	6	RETAIN	REMOVED	REMOVED	
3508	T1309	3508	811926.178	819438.326	旅人蕉	<i>Ravenala madagascariensis</i>	260	3	6	RETAIN	REMOVED	REMOVED	
3508	T1311	3508	811928.595	819439.056	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	REMOVED	REMOVED	
3508	T1312	3508	811929.597	819440.581	旅人蕉	<i>Ravenala madagascariensis</i>	190	2	5	RETAIN	REMOVED	REMOVED	
3508	T1313	3508	811930.015	819441.357	旅人蕉	<i>Ravenala madagascariensis</i>	190	2	5	RETAIN	REMOVED	REMOVED	
3508	T1314	3508	811929.186	819441.74	旅人蕉	<i>Ravenala madagascariensis</i>	170	2	5	RETAIN	REMOVED	REMOVED	
3508	T1315	3508	811930.532	819442.38	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	REMOVED	REMOVED	
3508	T1316	3508	811931.821	819443.589	旅人蕉	<i>Ravenala madagascariensis</i>	300	2	6	RETAIN	REMOVED	REMOVED	
3508	T1317	3508	811932.197	819444.38	旅人蕉	<i>Ravenala madagascariensis</i>	175	2	5	RETAIN	REMOVED	REMOVED	
3508	T1318	3508	811933.066	819445.972	旅人蕉	<i>Ravenala madagascariensis</i>	200	2	5	RETAIN	REMOVED	REMOVED	
3508	T1320	3508	811934.405	819448.343	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1321	3508	811935.366	819449.96	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	REMOVED	REMOVED	
3508	T1322	3508	811935.955	819450.822	旅人蕉	<i>Ravenala madagascariensis</i>	250	2	6	RETAIN	REMOVED	REMOVED	
3508	T1323	3508	811935.539	819452.067	旅人蕉	<i>Ravenala madagascariensis</i>	230	2	5	RETAIN	REMOVED	REMOVED	
3508	T1327	3508	811933.085	819449.616	旅人蕉	<i>Ravenala madagascariensis</i>	270	2	5	RETAIN	REMOVED	REMOVED	
3508	T1328	3508	811932.494	819448.234	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1329	3508	811932.029	819447.54	旅人蕉	<i>Ravenala madagascariensis</i>	285	2	5	RETAIN	REMOVED	REMOVED	
3508	T1330	3508	811931.222	819446.265	旅人蕉	<i>Ravenala madagascariensis</i>	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1331	3508	811930.509	819445.466	旅人蕉	<i>Ravenala madagascariensis</i>	255	2	5	RETAIN	REMOVED	REMOVED	
3508	T1332	3508	811930.2	819444.687	旅人蕉	<i>Ravenala madagascariensis</i>	215	2	5	RETAIN	REMOVED	REMOVED	
3508	T1333	3508	811930.235	819443.451	旅人蕉	<i>Ravenala madagascariensis</i>	240	2	5	RETAIN	REMOVED	REMOVED	
3508	T1377	3508	811483.52	820111.47	台灣相思	<i>Acacia confusa</i>	120	4	5	RETAIN	REMOVED	REMOVED	
3508	T1381A	3508	811871.959	819347.037	紅花夾竹桃	<i>Nerium oleander</i>	160	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022; Found fallen and removed in June 2023.
3508	T1382A	3508	811872.417	819347.825	紅花夾竹桃	<i>Nerium oleander</i>	95	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022; Confirmed dead due to unrecoverable health problems in Mar 2023.
3508	T1383	3508	811484.94	820118.79	黃槿	<i>Hibiscus tiliaceus</i>	120	1	1	RETAIN	REMOVED	REMOVED	
3508	T1384A	3508	811873.813	819349.865	紅花夾竹桃	<i>Nerium oleander</i>	110	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T1385A	3508	811875.347	819351.786	紅花夾竹桃	<i>Nerium oleander</i>	140	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	T1386A	3508	811875.808	819352.495	紅花夾竹桃	<i>Nerium oleander</i>	110	3	7	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	T1387A	3508	811876.93	819353.043	紅花夾竹桃	<i>Nerium oleander</i>	120	3	7	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	T1388A	3508	811876.582	819353.785	紅花夾竹桃	<i>Nerium oleander</i>	135	3	7	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	T1389A	3508	811877.166	819354.413	紅花夾竹桃	<i>Nerium oleander</i>	130	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	T1390A	3508	811877.969	819355.713	紅花夾竹桃	<i>Nerium oleander</i>	155	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Confirmed dead and removed in June 2024.
3508	T1391A	3508	811878.57	819356.315	紅花夾竹桃	<i>Nerium oleander</i>	160	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022; Confirmed dead due to unrecoverable health problems in Mar 2023.
3508	T1392A	3508	811878.787	819357.144	紅花夾竹桃	<i>Nerium oleander</i>	160	4	8	RETAIN	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	A3	3508	811873.1763	819348.8695	紅花夾竹桃	<i>Nerium oleander</i>	144	3	5	*	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	A4	3508	811870.6306	819344.4861	苦楝	<i>Melia azedarach</i>	166	6	9	*	REMOVED	REMOVED	Handed over to Contractor 3508 in Nov 2022. Removed due to poor conditions or conflicting with an existing building in Nov 2024.
3508	T1405	3508	811510.841	820137.951	銀合歡	<i>Leucaena leucocephala</i>	120	1	2	RETAIN	MISSING	MISSING	
3508	T1405A	3508	811774.025	819300.863	台灣相思	<i>Acacia confusa</i>	180	3	6	FELL	FELL	FELL	
3508	T1406A	3508	811774.709	819300.774	耳果相思	<i>Acacia auriculiformis</i>	305	6	12	FELL	FELL	FELL	
3508	T1407A	3508	811773.852	819303.562	台灣相思	<i>Acacia confusa</i>	195	4	10	FELL	FELL	FELL	
3508	T1408	3508	811777.131	819308.69	台灣相思	<i>Acacia confusa</i>	160	4	10	FELL	FELL	FELL	
3508	T1409	3508	811780.368	819309.182	耳果相思	<i>Acacia auriculiformis</i>	230	4	12	FELL	FELL	FELL	
3508	T1410A	3508	811778.834	819311.458	苦楝	<i>Melia azedarach</i>	275	4	12	FELL	FELL	FELL	
3508	T1411A	3508	811780.185	819314.314	台灣相思	<i>Acacia confusa</i>	145	3	7	FELL	FELL	FELL	
3508	T1412A	3508	811783.034	819313.585	耳果相思	<i>Acacia auriculiformis</i>	240	5	11	FELL	FELL	FELL	
3508	T1413A	3508	811782.069	819317.003	台灣相思	<i>Acacia confusa</i>	205	4	9	FELL	FELL	FELL	
3508	T1416A	3508	811786.869	819324.217	台灣相思	<i>Acacia confusa</i>	205	4	9	FELL	FELL	FELL	
3508	T1418A	3508	811788.345	819326.73	苦楝	<i>Melia azedarach</i>	205	5	12	FELL	FELL	FELL	
3508	T1419	3508	811789.486	819327.468	苦楝	<i>Melia azedarach</i>	300	8	12	FELL	FELL	FELL	
3508	T1420	3508	811790.446	819329.505	台灣相思	<i>Acacia confusa</i>	170	6	8	FELL	FELL	FELL	
3508	T1421	3508	811791.237	819327.128	台灣相思	<i>Acacia confusa</i>	175	5	9	FELL	FELL	FELL	
3508	T1423	3508	811791.696	819331.913	苦楝	<i>Melia azedarach</i>	270	6	12	FELL	FELL	FELL	
3508	T1424	3508	811792.984	819333.07	台灣相思	<i>Acacia confusa</i>	125	2	6	FELL	FELL	FELL	
3508	T1425	3508	811793.522	819333.981	台灣相思	<i>Acacia confusa</i>	145	4	9	FELL	FELL	FELL	
3508	T1429	3508	811794.895	819337.465	苦楝	<i>Melia azedarach</i>	350	1	1	FELL	FELL	FELL	
3508	T1430	3508	811796.24	819340.331	苦楝	<i>Melia azedarach</i>	265	8	10	FELL	FELL	FELL	
3508	T1431	3508	811797.401	819340.423	紅膠木	<i>Lophostemon confertus</i>	105	3	6	FELL	FELL	FELL	
3508	T1432	3508	811797.989	819342.986	台灣相思	<i>Acacia confusa</i>	160	4	8	FELL	FELL	FELL	
3508	T1433	3508	811799.895	819344.938	紅膠木	<i>Lophostemon confertus</i>	115	4	5	FELL	FELL	FELL	
3508	T1434	3508	811799.719	819345.603	苦楝	<i>Melia azedarach</i>	320	5	10	FELL	FELL	FELL	
3508	T1437	3508	811803.951	819349.669	苦楝	<i>Melia azedarach</i>	250	6	12	FELL	FELL	FELL	
3508	T1438	3508	811804.925	819351.554	苦楝	<i>Melia azedarach</i>	150	4	6	FELL	FELL	FELL	
3508	T1439	3508	811805.739	819352.436	苦楝	<i>Melia azedarach</i>	350	8	12	FELL	FELL	FELL	
3508	T1440	3508	811802.891	819351.494	台灣相思	<i>Acacia confusa</i>	160	3	6	FELL	FELL	FELL	
3508	T1441A	3508	811804.654	819354.468	台灣相思	<i>Acacia confusa</i>	170	3	6	FELL	FELL	FELL	
3508	T1442A	3508	811806.079	819357.49	苦楝	<i>Melia azedarach</i>	215	5	12	FELL	FELL	FELL	
3508	T1443A	3508	811807.735	819360.366	苦楝	<i>Melia azedarach</i>	350	8	12	FELL	FELL	FELL	
3508	T1444A	3508	811809.276	819363.503	苦楝	<i>Melia azedarach</i>	320	10	10	FELL	FELL	FELL	
3508	T1445A	3508	811823.746	819344.693	台灣相思	<i>Acacia confusa</i>	235	8	12	FELL	FELL	FELL	
3508	T1446A	3508	811822.287	819342.18	苦楝	<i>Melia azedarach</i>	205	8	12	FELL	FELL	FELL	
3508	T1447A	3508	811815.695	819338.36	耳果相思	<i>Acacia auriculiformis</i>	265	6	11	FELL	FELL	FELL	
3508	T1448A	3508	811818.224	819336.991	台灣相思	<i>Acacia confusa</i>	175	4	8	FELL	FELL	FELL	
3508	T1449A	3508	811818.995	819336.91	台灣相思	<i>Acacia confusa</i>	320	8	12	FELL	FELL	FELL	
3508	T1450A	3508	811817.437	819334.836	耳果相思	<i>Acacia auriculiformis</i>	215	8	10	FELL	FELL	FELL	
3508	T1452A	3508	811812.384	819326.2	台灣相思	<i>Acacia confusa</i>	345	8	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T1453A	3508	811810.122	819324.896	苦楝	Melia azedarach	190	6	10	FELL	FELL	FELL	
3508	T1454A	3508	811809.509	819323.894	苦楝	Melia azedarach	295	6	14	FELL	FELL	FELL	
3508	T1455A	3508	811807.152	819325.754	耳果相思	Acacia auriculiformis	225	8	12	FELL	FELL	FELL	
3508	T1457A	3508	811806.964	819319.115	台灣相思	Acacia confusa	205	7	12	FELL	FELL	FELL	
3508	T1458A	3508	811806.64	819317.457	台灣相思	Acacia confusa	95	3	8	FELL	FELL	FELL	
3508	T1459A	3508	811805.755	819317.146	台灣相思	Acacia confusa	190	6	10	FELL	FELL	FELL	
3508	T1460A	3508	811805.329	819316.167	台灣相思	Acacia confusa	155	6	12	FELL	FELL	FELL	
3508	T1461A	3508	811804.911	819317.042	台灣相思	Acacia confusa	135	4	8	FELL	FELL	FELL	
3508	T1462A	3508	811804.537	819315.102	台灣相思	Acacia confusa	170	4	10	FELL	FELL	FELL	
3508	T1463A	3508	811803.783	819314.253	台灣相思	Acacia confusa	170	4	9	FELL	FELL	FELL	
3508	T1464A	3508	811802.874	819314.158	台灣相思	Acacia confusa	170	4	9	FELL	FELL	FELL	
3508	T1465A	3508	811802.905	819311.623	苦楝	Melia azedarach	260	6	12	FELL	FELL	FELL	
3508	T1466A	3508	811799.036	819313.178	耳果相思	Acacia auriculiformis	380	10	12	FELL	FELL	FELL	
3508	T1467A	3508	811799.243	819308.493	紅膠木	Lophostemon confertus	120	4	8	FELL	FELL	FELL	
3508	T1469A	3508	811796.29	819308.829	耳果相思	Acacia auriculiformis	240	8	10	FELL	FELL	FELL	
3508	T1471A	3508	811794.421	819300.437	大葉相思	Acacia mangium	170	4	8	FELL	FELL	FELL	
3508	T1476	3508	811787.154	819290.546	台灣相思	Acacia confusa	230	8	12	FELL	FELL	FELL	
3508	T1477	3508	811769.404	819269.417	耳果相思	Acacia auriculiformis	260	6	12	FELL	FELL	FELL	
3508	T1478	3508	811934.331	819409.923	旅人蕉	Ravenala madagascariensis	220	2	5	RETAIN	REMOVED	REMOVED	
3508	T1479	3508	811935.653	819409.353	旅人蕉	Ravenala madagascariensis	285	2	5	RETAIN	REMOVED	REMOVED	
3508	T1480	3508	811936.828	819407.401	旅人蕉	Ravenala madagascariensis	175	2	5	RETAIN	REMOVED	REMOVED	
3508	T1481	3508	811941.453	819402.796	旅人蕉	Ravenala madagascariensis	255	3	5	RETAIN	REMOVED	REMOVED	
3508	T1482	3508	811942.687	819402.386	旅人蕉	Ravenala madagascariensis	230	3	5	RETAIN	REMOVED	REMOVED	
3508	T1483	3508	811946.659	819399.578	旅人蕉	Ravenala madagascariensis	220	3	5	RETAIN	REMOVED	REMOVED	
3508	T1484	3508	811946.896	819400.401	旅人蕉	Ravenala madagascariensis	300	3	6	RETAIN	REMOVED	REMOVED	
3508	T1491	3508	811990.215	819347.091	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1492	3508	811991.883	819349.564	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1493	3508	811989.307	819351.254	椰子	Cocos nucifera	280	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1494	3508	811993.551	819351.991	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1495	3508	811992.617	819356.109	椰子	Cocos nucifera	230	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1496	3508	811994.227	819358.466	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1497	3508	811995.885	819360.927	椰子	Cocos nucifera	310	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1498	3508	811998.599	819359.242	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1499	3508	812000.382	819361.73	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1500	3508	812002.163	819364.494	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1501	3508	812003.526	819366.622	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1502	3508	812001.218	819368.586	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1503	3508	812002.906	819371.18	椰子	Cocos nucifera	260	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1504	3508	812005.411	819369.3	椰子	Cocos nucifera	285	4	6	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3508	T1506	3508	812006.324	819375.896	椰子	Cocos nucifera	255	4	6	RETAIN	RETAIN	RETAIN	
3508	T1507	3508	812008.042	819378.517	椰子	Cocos nucifera	250	4	6	RETAIN	RETAIN	RETAIN	
3508	T1508	3508	812009.773	819381.001	椰子	Cocos nucifera	230	4	5	RETAIN	RETAIN	RETAIN	
3508	T1509	3508	812011.488	819383.414	椰子	Cocos nucifera	300	4	6	RETAIN	RETAIN	RETAIN	
3508	T1512	3508	812014.255	819386.336	椰子	Cocos nucifera	280	4	6	RETAIN	RETAIN	RETAIN	
3508	T1514	3508	812016.634	819391.046	椰子	Cocos nucifera	300	4	6	RETAIN	RETAIN	RETAIN	
3508	T1515	3508	812018.437	819393.493	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1518	3508	812020.135	819395.886	椰子	Cocos nucifera	230	4	6	RETAIN	RETAIN	RETAIN	
3508	T1519	3508	812021.876	819398.428	椰子	Cocos nucifera	230	4	6	RETAIN	RETAIN	RETAIN	
3508	T1521	3508	812023.537	819401.022	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1522	3508	812027.183	819406.119	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1524	3508	812032.541	819413.666	椰子	Cocos nucifera	220	4	6	RETAIN	RETAIN	RETAIN	
3508	T1525	3508	812034.273	819416.273	椰子	Cocos nucifera	285	4	5	RETAIN	RETAIN	RETAIN	
3508	T1527	3508	812037.898	819421.007	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1528	3508	812039.583	819423.549	椰子	Cocos nucifera	285	4	6	RETAIN	RETAIN	RETAIN	
3508	T1531	3508	812041.338	819426.334	椰子	Cocos nucifera	265	4	5	RETAIN	RETAIN	RETAIN	
3508	T1532	3508	812042.917	819428.646	椰子	Cocos nucifera	240	4	6	RETAIN	RETAIN	RETAIN	
3508	T1536	3508	812046.331	819433.584	椰子	Cocos nucifera	270	4	5	RETAIN	RETAIN	RETAIN	
3508	T3157	3508	811722.863	819371.335	大葉相思	Acacia mangium	110	2	7	FELL	FELL	FELL	
3508	T3158	3508	811721.163	819371.569	黃槿	Hibiscus tiliaceus	135	3	7	FELL	FELL	FELL	
3508	T3159	3508	811721.145	819372.531	台灣相思	Acacia confusa	150	3	7	FELL	FELL	FELL	
3508	T3160	3508	811720.145	819372.855	黃槿	Hibiscus tiliaceus	100	3	7	FELL	FELL	FELL	
3508	T3161	3508	811721.382	819374.136	台灣相思	Acacia confusa	190	6	8	FELL	FELL	FELL	
3508	T3162	3508	811720.714	819375.912	台灣相思	Acacia confusa	155	3	8	FELL	FELL	FELL	
3508	T3163	3508	811722.299	819375.571	台灣相思	Acacia confusa	225	6	10	FELL	FELL	FELL	
3508	T3165	3508	811724.192	819377.515	宮粉羊蹄甲	Bauhinia variegata	105	4	6	FELL	FELL	FELL	
3508	T3168	3508	811724.749	819383.442	台灣相思	Acacia confusa	285	8	10	FELL	FELL	FELL	
3508	T3169	3508	811722.095	819386.336	潺槁樹	Litsea glutinosa	100	4	6	FELL	FELL	FELL	
3508	T3170	3508	811721.285	819386.955	大葉相思	Acacia mangium	170	4	8	FELL	FELL	FELL	
3508	T3171	3508	811720.311	819387.349	大葉相思	Acacia mangium	215	6	10	FELL	FELL	FELL	
3508	T3172	3508	811721.558	819386.087	大葉相思	Acacia mangium	270	6	10	FELL	FELL	FELL	
3508	T3173	3508	811718.255	819386.706	大葉相思	Acacia mangium	125	4	9	FELL	FELL	FELL	
3508	T3174	3508	811719.675	819385.118	大葉相思	Acacia mangium	115	1	0	FELL	FELL	FELL	
3508	T3176	3508	811717.544	819386.181	大葉相思	Acacia mangium	205	4	9	FELL	FELL	FELL	
3508	T3177	3508	811719.098	819381.592	台灣相思	Acacia confusa	210	6	10	FELL	FELL	FELL	
3508	T3178	3508	811714.848	819381.594	台灣相思	Acacia confusa	150	6	9	FELL	FELL	FELL	
3508	T3179	3508	811713.955	819381.559	台灣相思	Acacia confusa	220	6	9	FELL	FELL	FELL	
3508	T3180	3508	811715.391	819378.192	台灣相思	Acacia confusa	165	6	10	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T3181	3508	811715.95	819376.568	台灣相思	Acacia confusa	135	4	10	FELL	FELL	FELL	
3508	T3183	3508	811719.177	819377.271	台灣相思	Acacia confusa	155	4	10	FELL	FELL	FELL	
3508	T3211	3508	811697.113	819405.346	台灣相思	Acacia confusa	290	8	9	FELL	FELL	FELL	
3508	T3212	3508	811696.127	819402.697	潺槁樹	Litsea glutinosa	120	3	7	FELL	FELL	FELL	
3508	T3213	3508	811696.559	819401.431	苦楝	Melia azedarach	155	5	7	FELL	FELL	FELL	
3508	T3214	3508	811701.332	819397.298	宮粉羊蹄甲	Bauhinia variegata	170	7	7	FELL	FELL	FELL	
3508	T3215	3508	811708.882	819395.503	大葉相思	Acacia mangium	180	6	10	FELL	FELL	FELL	
3508	T3216	3508	811708.785	819394.555	大葉相思	Acacia mangium	235	6	10	FELL	FELL	FELL	
3508	T3217	3508	811705.023	819394.006	大葉相思	Acacia mangium	180	4	7	FELL	FELL	FELL	
3508	T3218	3508	811707.126	819392.027	苦楝	Melia azedarach	115	3	7	FELL	FELL	FELL	
3508	T3219	3508	811707.871	819391.142	潺槁樹	Litsea glutinosa	100	3	5	FELL	FELL	FELL	
3508	T3241	3508	811784.996	819372.228	旅人蕉	Ravenala madagascariensis	195	2	5	FELL	FELL	FELL	
3508	T3242	3508	811784.572	819370.879	旅人蕉	Ravenala madagascariensis	190	2	5	FELL	FELL	FELL	
3508	T3243	3508	811783.564	819371.308	旅人蕉	Ravenala madagascariensis	205	3	7	FELL	FELL	FELL	
3508	T3244	3508	811782.355	819371.912	旅人蕉	Ravenala madagascariensis	250	3	7	FELL	FELL	FELL	
3508	T3245	3508	811781.988	819371.135	旅人蕉	Ravenala madagascariensis	225	2	7	FELL	FELL	FELL	
3508	T3246	3508	811781.333	819371.272	旅人蕉	Ravenala madagascariensis	205	2	5	FELL	FELL	FELL	
3508	T3247	3508	811781.182	819370.349	旅人蕉	Ravenala madagascariensis	180	2	5	FELL	FELL	FELL	
3508	T3249	3508	811779.345	819371.573	旅人蕉	Ravenala madagascariensis	190	2	4	FELL	FELL	FELL	
3508	T3251	3508	811779.58	819369.814	旅人蕉	Ravenala madagascariensis	225	2	5	FELL	FELL	FELL	
3508	T3252	3508	811778.849	819369.583	旅人蕉	Ravenala madagascariensis	300	3	6	FELL	FELL	FELL	
3508	T3253	3508	811778.456	819371.121	旅人蕉	Ravenala madagascariensis	240	2	5	FELL	FELL	FELL	
3508	T3254	3508	811778.312	819371.932	旅人蕉	Ravenala madagascariensis	160	1	4	FELL	FELL	FELL	
3508	T3257	3508	811776.588	819367.776	旅人蕉	Ravenala madagascariensis	320	3	6	FELL	FELL	FELL	
3508	T3258	3508	811775.177	819367.931	旅人蕉	Ravenala madagascariensis	185	2	5	FELL	FELL	FELL	
3508	T3259	3508	811775.361	819369.156	旅人蕉	Ravenala madagascariensis	250	3	5	FELL	FELL	FELL	
3508	T3261	3508	811773.379	819369.093	旅人蕉	Ravenala madagascariensis	195	3	5	FELL	FELL	FELL	
3508	T3262	3508	811774.002	819368.351	旅人蕉	Ravenala madagascariensis	180	2	5	FELL	FELL	FELL	
3508	T3263	3508	811771.89	819366.486	旅人蕉	Ravenala madagascariensis	190	2	4	FELL	FELL	FELL	
3508	T3264	3508	811771.088	819366.016	旅人蕉	Ravenala madagascariensis	240	3	7	FELL	FELL	FELL	
3508	T3265	3508	811769.706	819366.018	旅人蕉	Ravenala madagascariensis	195	2	5	FELL	FELL	FELL	
3508	T3266	3508	811770.781	819365.088	旅人蕉	Ravenala madagascariensis	190	2	4	FELL	MISSING	MISSING	
3508	T3267	3508	811769.313	819365.038	旅人蕉	Ravenala madagascariensis	240	3	6	FELL	FELL	FELL	
3508	T3268	3508	811769.131	819363.843	旅人蕉	Ravenala madagascariensis	250	4	7	FELL	FELL	FELL	
3508	T3269	3508	811768.539	819363.532	旅人蕉	Ravenala madagascariensis	190	2	5	FELL	FELL	FELL	
3508	T3270	3508	811767.228	819363.494	旅人蕉	Ravenala madagascariensis	275	4	7	FELL	FELL	FELL	
3508	T3271	3508	811766.091	819363.28	旅人蕉	Ravenala madagascariensis	195	4	6	FELL	FELL	FELL	
3508	T3272	3508	811766.769	819362.548	旅人蕉	Ravenala madagascariensis	190	2	4	FELL	FELL	FELL	
3508	T3274	3508	811765.133	819362.515	旅人蕉	Ravenala madagascariensis	175	3	6	FELL	FELL	FELL	
3508	T3275	3508	811766.086	819361.46	旅人蕉	Ravenala madagascariensis	265	4	7	FELL	FELL	FELL	
3508	T3276	3508	811763.267	819362.075	旅人蕉	Ravenala madagascariensis	215	4	7	FELL	FELL	FELL	
3508	T3277	3508	811763.26	819362.943	旅人蕉	Ravenala madagascariensis	225	4	7	FELL	FELL	FELL	
3508	T3278	3508	811762.231	819362.993	旅人蕉	Ravenala madagascariensis	210	4	7	FELL	FELL	FELL	
3508	T3280	3508	811761.398	819362.354	旅人蕉	Ravenala madagascariensis	180	4	6	FELL	FELL	FELL	
3508	T3281	3508	811761.25	819360.106	旅人蕉	Ravenala madagascariensis	210	3	6	FELL	FELL	FELL	
3508	T3282	3508	811760.004	819359.739	旅人蕉	Ravenala madagascariensis	180	3	6	FELL	MISSING	MISSING	
3508	T3283	3508	811759.698	819360.757	旅人蕉	Ravenala madagascariensis	220	4	7	FELL	FELL	FELL	
3508	T3284	3508	811759.299	819361.152	旅人蕉	Ravenala madagascariensis	215	4	7	FELL	FELL	FELL	
3508	T3285	3508	811758.618	819360.88	旅人蕉	Ravenala madagascariensis	210	5	7	FELL	FELL	FELL	
3508	T3286	3508	811758.691	819360.538	旅人蕉	Ravenala madagascariensis	240	5	7	FELL	FELL	FELL	
3508	T3287	3508	811762.395	819358.787	旅人蕉	Ravenala madagascariensis	190	4	6	FELL	FELL	FELL	
3508	T3288	3508	811759.039	819358.441	旅人蕉	Ravenala madagascariensis	230	4	7	FELL	FELL	FELL	
3508	T3289	3508	811758.127	819358.081	旅人蕉	Ravenala madagascariensis	225	2	4	FELL	FELL	FELL	
3508	T3290	3508	811757.34	819357.477	旅人蕉	Ravenala madagascariensis	170	3	6	FELL	FELL	FELL	
3508	T3291	3508	811757.98	819356.907	旅人蕉	Ravenala madagascariensis	200	4	6	FELL	FELL	FELL	
3508	T3292	3508	811759.728	819357.014	旅人蕉	Ravenala madagascariensis	260	3	6	FELL	FELL	FELL	
3508	T3293	3508	811758.928	819356.538	旅人蕉	Ravenala madagascariensis	260	3	7	FELL	FELL	FELL	
3508	T3295	3508	811757.189	819356.424	旅人蕉	Ravenala madagascariensis	195	4	7	FELL	FELL	FELL	
3508	T3297	3508	811756.592	819355.333	旅人蕉	Ravenala madagascariensis	215	4	7	FELL	FELL	FELL	
3508	T3298	3508	811756.309	819353.534	旅人蕉	Ravenala madagascariensis	205	2	4	FELL	FELL	FELL	
3508	T3299	3508	811758.065	819353.885	旅人蕉	Ravenala madagascariensis	210	4	7	FELL	FELL	FELL	
3508	T3300	3508	811759.973	819354.088	旅人蕉	Ravenala madagascariensis	260	4	7	FELL	FELL	FELL	
3508	T3301	3508	811758.85	819353.072	旅人蕉	Ravenala madagascariensis	275	4	7	FELL	FELL	FELL	
3508	T3302	3508	811757.3	819352.962	旅人蕉	Ravenala madagascariensis	170	2	4	FELL	FELL	FELL	
3508	T3303	3508	811757.191	819352.096	旅人蕉	Ravenala madagascariensis	220	3	6	FELL	FELL	FELL	
3508	T3304	3508	811757.087	819351.718	旅人蕉	Ravenala madagascariensis	235	4	7	FELL	FELL	FELL	
3508	T3305	3508	811757.216	819350.691	旅人蕉	Ravenala madagascariensis	170	2	5	FELL	FELL	FELL	
3508	T3306	3508	811756.398	819350.596	旅人蕉	Ravenala madagascariensis	195	3	7	FELL	FELL	FELL	
3508	T3307	3508	811757.131	819350.006	旅人蕉	Ravenala madagascariensis	175	3	6	FELL	FELL	FELL	
3508	T3308	3508	811757.886	819350.317	旅人蕉	Ravenala madagascariensis	230	4	7	FELL	FELL	FELL	
3508	T3309	3508	811757.174	819349.127	旅人蕉	Ravenala madagascariensis	215	4	7	FELL	FELL	FELL	
3508	T3310	3508	811756.203	819349.138	旅人蕉	Ravenala madagascariensis	165	2	4	FELL	FELL	FELL	
3508	T3311	3508	811756.135	819348.567	旅人蕉	Ravenala madagascariensis	210	3	7	FELL	FELL	FELL	
3508	T3312	3508	811756.021	819347.646	旅人蕉	Ravenala madagascariensis	185	2	6	FELL	FELL	FELL	
3508	T3313	3508	811755.943	819346.761	旅人蕉	Ravenala madagascariensis	230	3	7	FELL	FELL	FELL	
3508	T3314	3508	811755.74	819345.509	旅人蕉	Ravenala madagascariensis	215	4	6	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T3315	3508	811756.436	819345.096	旅人蕉	<i>Ravenala madagascariensis</i>	190	4	6	FELL	FELL	FELL	
3508	T3316	3508	811757.139	819345.071	旅人蕉	<i>Ravenala madagascariensis</i>	225	4	7	FELL	FELL	FELL	
3508	T3317	3508	811755.759	819344.188	旅人蕉	<i>Ravenala madagascariensis</i>	160	2	4	FELL	FELL	FELL	
3508	T3318	3508	811755.53	819343.109	旅人蕉	<i>Ravenala madagascariensis</i>	175	3	5	FELL	FELL	FELL	
3508	T3319	3508	811756.33	819342.842	旅人蕉	<i>Ravenala madagascariensis</i>	210	3	7	FELL	FELL	FELL	
3508	T3320	3508	811757.238	819342.267	旅人蕉	<i>Ravenala madagascariensis</i>	240	4	7	FELL	FELL	FELL	
3508	T3321	3508	811756.174	819341.593	旅人蕉	<i>Ravenala madagascariensis</i>	240	4	6	FELL	FELL	FELL	
3508	T3322	3508	811755.457	819341.648	旅人蕉	<i>Ravenala madagascariensis</i>	225	4	7	FELL	FELL	FELL	
3508	T3323	3508	811755.869	819339.663	旅人蕉	<i>Ravenala madagascariensis</i>	220	4	7	FELL	FELL	FELL	
3508	T3324	3508	811756.684	819338.653	旅人蕉	<i>Ravenala madagascariensis</i>	255	4	7	FELL	FELL	FELL	
3508	T3325	3508	811755.798	819338.158	旅人蕉	<i>Ravenala madagascariensis</i>	155	2	4	FELL	FELL	FELL	
3508	T3326	3508	811754.877	819336.811	旅人蕉	<i>Ravenala madagascariensis</i>	225	4	7	FELL	FELL	FELL	
3508	T3327	3508	811754.671	819335.895	旅人蕉	<i>Ravenala madagascariensis</i>	190	4	7	FELL	FELL	FELL	
3508	T3329	3508	811756.388	819336.699	旅人蕉	<i>Ravenala madagascariensis</i>	240	4	7	FELL	FELL	FELL	
3508	T3330	3508	811756.242	819335.482	旅人蕉	<i>Ravenala madagascariensis</i>	290	4	7	FELL	FELL	FELL	
3508	T3331	3508	811756.938	819334.873	旅人蕉	<i>Ravenala madagascariensis</i>	295	4	6	FELL	FELL	FELL	
3508	T3332	3508	811757.091	819335.5	旅人蕉	<i>Ravenala madagascariensis</i>	215	4	7	FELL	FELL	FELL	
3508	T3333	3508	811757.537	819336.435	旅人蕉	<i>Ravenala madagascariensis</i>	250	4	7	FELL	FELL	FELL	
3508	T3334	3508	811757.404	819337.117	旅人蕉	<i>Ravenala madagascariensis</i>	195	3	5	FELL	FELL	FELL	
3508	T3335	3508	811757.6	819337.982	旅人蕉	<i>Ravenala madagascariensis</i>	155	4	6	FELL	FELL	FELL	
3508	T3336	3508	811758.023	819338.924	旅人蕉	<i>Ravenala madagascariensis</i>	270	4	7	FELL	FELL	FELL	
3508	T3337	3508	811758.152	819340.682	旅人蕉	<i>Ravenala madagascariensis</i>	170	2	5	FELL	FELL	FELL	
3508	T3338	3508	811758.257	819341.327	旅人蕉	<i>Ravenala madagascariensis</i>	135	3	6	FELL	FELL	FELL	
3508	T3339	3508	811758.517	819343.514	旅人蕉	<i>Ravenala madagascariensis</i>	205	4	6	FELL	FELL	FELL	
3508	T3340	3508	811758.605	819344.168	旅人蕉	<i>Ravenala madagascariensis</i>	245	4	7	FELL	FELL	FELL	
3508	T3341	3508	811757.826	819345.021	旅人蕉	<i>Ravenala madagascariensis</i>	240	4	7	FELL	FELL	FELL	
3508	T3343	3508	811758.711	819345.938	旅人蕉	<i>Ravenala madagascariensis</i>	200	4	7	FELL	FELL	FELL	
3508	T3344	3508	811759.072	819346.491	旅人蕉	<i>Ravenala madagascariensis</i>	225	5	7	FELL	FELL	FELL	
3508	T3345	3508	811757.945	819346.755	旅人蕉	<i>Ravenala madagascariensis</i>	215	5	9	FELL	FELL	FELL	
3508	T3346	3508	811759.372	819349.598	旅人蕉	<i>Ravenala madagascariensis</i>	205	4	9	FELL	FELL	FELL	
3508	T3347	3508	811760.149	819349.718	旅人蕉	<i>Ravenala madagascariensis</i>	210	4	8	FELL	FELL	FELL	
3508	T3348	3508	811760.521	819350.578	旅人蕉	<i>Ravenala madagascariensis</i>	220	4	8	FELL	FELL	FELL	
3508	T3349	3508	811759.632	819351.472	旅人蕉	<i>Ravenala madagascariensis</i>	220	4	8	FELL	FELL	FELL	
3508	T3351	3508	811762.121	819353.723	旅人蕉	<i>Ravenala madagascariensis</i>	175	5	8	FELL	FELL	FELL	
3508	T3352	3508	811761.623	819354.983	旅人蕉	<i>Ravenala madagascariensis</i>	180	4	6	FELL	FELL	FELL	
3508	T3354	3508	811761.639	819356.48	旅人蕉	<i>Ravenala madagascariensis</i>	300	5	9	FELL	FELL	FELL	
3508	T3359	3508	811764.302	819356.455	旅人蕉	<i>Ravenala madagascariensis</i>	180	5	7	FELL	FELL	FELL	
3508	T3360	3508	811763.732	819357.017	旅人蕉	<i>Ravenala madagascariensis</i>	175	4	7	FELL	FELL	FELL	
3508	T3362	3508	811763.889	819357.764	旅人蕉	<i>Ravenala madagascariensis</i>	215	5	9	FELL	FELL	FELL	
3508	T3363	3508	811759.15	819359.067	旅人蕉	<i>Ravenala madagascariensis</i>	205	5	8	FELL	MISSING	MISSING	
3508	T3365	3508	811760.324	819363.114	旅人蕉	<i>Ravenala madagascariensis</i>	230	4	6	FELL	FELL	FELL	
3508	T3366	3508	811761.428	819363.506	旅人蕉	<i>Ravenala madagascariensis</i>	230	3	5	FELL	FELL	FELL	
3508	T3367	3508	811763.679	819359.981	旅人蕉	<i>Ravenala madagascariensis</i>	215	5	8	FELL	FELL	FELL	
3508	T3368	3508	811763.718	819359.146	旅人蕉	<i>Ravenala madagascariensis</i>	225	5	9	FELL	FELL	FELL	
3508	T3369	3508	811764.646	819359.399	旅人蕉	<i>Ravenala madagascariensis</i>	240	5	8	FELL	FELL	FELL	
3508	T3370	3508	811764.844	819360.38	旅人蕉	<i>Ravenala madagascariensis</i>	215	5	8	FELL	FELL	FELL	
3508	T3371	3508	811765.707	819358.939	旅人蕉	<i>Ravenala madagascariensis</i>	300	6	10	FELL	FELL	FELL	
3508	T3372	3508	811765.346	819357.231	旅人蕉	<i>Ravenala madagascariensis</i>	190	4	7	FELL	FELL	FELL	
3508	T3374	3508	811766.017	819358.613	旅人蕉	<i>Ravenala madagascariensis</i>	170	5	8	FELL	FELL	FELL	
3508	T3375	3508	811766.919	819359.104	旅人蕉	<i>Ravenala madagascariensis</i>	150	1	4	FELL	FELL	FELL	
3508	T3376	3508	811766.847	819359.968	旅人蕉	<i>Ravenala madagascariensis</i>	180	4	6	FELL	FELL	FELL	
3508	T3377	3508	811766.274	819360.745	旅人蕉	<i>Ravenala madagascariensis</i>	215	4	8	FELL	FELL	FELL	
3508	T3378	3508	811767.684	819360.406	旅人蕉	<i>Ravenala madagascariensis</i>	260	5	8	FELL	MISSING	MISSING	
3508	T3381	3508	811768.397	819361.218	旅人蕉	<i>Ravenala madagascariensis</i>	255	5	8	FELL	FELL	FELL	
3508	T3382	3508	811768.024	819362.166	旅人蕉	<i>Ravenala madagascariensis</i>	235	5	8	FELL	FELL	FELL	
3508	T3383	3508	811769.153	819362.035	旅人蕉	<i>Ravenala madagascariensis</i>	220	5	8	FELL	FELL	FELL	
3508	T3384	3508	811770.043	819361.481	旅人蕉	<i>Ravenala madagascariensis</i>	240	4	8	FELL	FELL	FELL	
3508	T3385	3508	811770.777	819361.827	旅人蕉	<i>Ravenala madagascariensis</i>	205	5	8	FELL	FELL	FELL	
3508	T3386	3508	811771.22	819362.531	旅人蕉	<i>Ravenala madagascariensis</i>	170	4	7	FELL	FELL	FELL	
3508	T3387	3508	811771.576	819363.64	旅人蕉	<i>Ravenala madagascariensis</i>	190	4	6	FELL	FELL	FELL	
3508	T3389	3508	811772.795	819363.644	旅人蕉	<i>Ravenala madagascariensis</i>	240	5	8	FELL	FELL	FELL	
3508	T3390	3508	811772.675	819365.467	旅人蕉	<i>Ravenala madagascariensis</i>	210	4	8	FELL	FELL	FELL	
3508	T3391	3508	811773.112	819365.981	旅人蕉	<i>Ravenala madagascariensis</i>	180	4	8	FELL	FELL	FELL	
3508	T3392	3508	811774.552	819366.576	旅人蕉	<i>Ravenala madagascariensis</i>	225	5	9	FELL	FELL	FELL	
3508	T3393	3508	811775.034	819365.948	旅人蕉	<i>Ravenala madagascariensis</i>	265	5	7	FELL	FELL	FELL	
3508	T3394	3508	811775.921	819365.872	旅人蕉	<i>Ravenala madagascariensis</i>	205	5	7	FELL	FELL	FELL	
3508	T3396	3508	811777.003	819366.688	旅人蕉	<i>Ravenala madagascariensis</i>	260	3	5	FELL	FELL	FELL	
3508	T3397	3508	811777.758	819367.55	旅人蕉	<i>Ravenala madagascariensis</i>	210	5	7	FELL	FELL	FELL	
3508	T3398	3508	811777.985	819367.917	旅人蕉	<i>Ravenala madagascariensis</i>	220	5	9	FELL	FELL	FELL	
3508	T3401	3508	811780.723	819368.723	旅人蕉	<i>Ravenala madagascariensis</i>	240	5	9	FELL	FELL	FELL	
3508	T3402	3508	811781.586	819368.578	旅人蕉	<i>Ravenala madagascariensis</i>	275	5	9	FELL	FELL	FELL	
3508	T3403	3508	811782.707	819368.416	旅人蕉	<i>Ravenala madagascariensis</i>	225	5	8	FELL	FELL	FELL	
3508	T3406	3508	811783.636	819368.51	旅人蕉	<i>Ravenala madagascariensis</i>	190	4	7	FELL	FELL	FELL	
3508	T3407	3508	811783.556	819368.971	旅人蕉	<i>Ravenala madagascariensis</i>	165	3	6	FELL	FELL	FELL	
3508	T01HK	N/A	811496.08	819846.25	細葉榕	<i>Ficus microcarpa</i>	150	7	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T02HK	N/A	811510.247	819805.106	細葉榕	<i>Ficus microcarpa</i>	150	7	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T1230	N/A	811955.808	819463.969	耳果相思	Acacia auriculiformis	320	7	11	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1231	N/A	811954.369	819466.181	旅人蕉	Ravenala madagascariensis	220	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1232	N/A	811953.456	819466.539	旅人蕉	Ravenala madagascariensis	200	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1233	N/A	811953.809	819465.779	旅人蕉	Ravenala madagascariensis	190	2	4	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1234	N/A	811952.497	819464.64	旅人蕉	Ravenala madagascariensis	200	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1235	N/A	811951.646	819464.563	旅人蕉	Ravenala madagascariensis	200	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1335	3508	811947.14	819456.731	苦楝	Melia azedarach	150	5	7	RETAIN	REMOVED	REMOVED	Previously tagged as T1270B.
3508	T1242	N/A	811951.379	819463.411	旅人蕉	Ravenala madagascariensis	220	2	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1243	N/A	811950.501	819463.08	旅人蕉	Ravenala madagascariensis	230	2	4	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1384	N/A	811485.55	820119.16	黄槿	Hibiscus tiliaceus	150	1	1	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1389	N/A	811489.72	820124.5	大葉相思	Acacia mangium	230	4	7	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1485A	N/A	811948.306	819398.649	旅人蕉	Ravenala madagascariensis	290	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1486	N/A	811958.015	819391.869	旅人蕉	Ravenala madagascariensis	285	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1487	N/A	811959.266	819392.679	旅人蕉	Ravenala madagascariensis	270	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1488	N/A	811960.148	819390.381	旅人蕉	Ravenala madagascariensis	185	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1489	N/A	811960.66	819389.932	旅人蕉	Ravenala madagascariensis	205	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T1490	N/A	811963.219	819389.753	旅人蕉	Ravenala madagascariensis	250	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T2906	N/A	811459.93	820075.367	台灣相思	Acacia confusa	180	3	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T3038	3508	811627.673	819443.421	黄槿	Hibiscus tiliaceus	140	5	5	FELL	FELL	FELL	
3508	T3038A	3508	811623.973	819443.742	耳果相思	Acacia auriculiformis	100	2	8	FELL	FELL	FELL	
3508	T3038B	3508	811626.242	819440.901	耳果相思	Acacia auriculiformis	130	4	8	FELL	FELL	FELL	
3508	T3039	3508	811631.266	819438.686	黄槿	Hibiscus tiliaceus	150	4	5	FELL	FELL	FELL	
3508	T3046	3508	811640.969	819395.303	王棕	Roystonea regia	225	2	6	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3047	3508	811642.989	819389.785	王棕	Roystonea regia	190	2	6	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3048	3508	811644.918	819384.088	王棕	Roystonea regia	215	2	6	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3049	3508	811645.891	819381.117	王棕	Roystonea regia	225	2	5	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3050	3508	811646.859	819378.305	王棕	Roystonea regia	225	3	6	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3051	3508	811647.903	819375.532	王棕	Roystonea regia	240	2	6	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3052	3508	811648.734	819372.619	王棕	Roystonea regia	250	2	7	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3053	3508	811649.705	819369.908	王棕	Roystonea regia	205	2	6	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3054	3508	811650.614	819366.797	王棕	Roystonea regia	180	2	7	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3055	3508	811651.805	819364.094	王棕	Roystonea regia	250	2	7	TRANSPLANT	FELL	FELL	Transplanting was not recommended due to poor health condition and low amenity value. Felled in Dec 2023.
3508	T3056	N/A	811672.481	819340.2	鐵刀木	Senna siamea	165	6	9	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T3058	3508	811672.122	819335.454	鐵刀木	Senna siamea	130	4	9	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3059	N/A	811668.864	819333.681	鐵刀木	Senna siamea	180	6	9	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T3063	N/A	811673.151	819325.262	椰子	Cocos nucifera	250	4	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	Confirmed not locate within 3RS works area.
3508	T3071	3508	811683.438	819357.281	苦楝	Melia azedarach	215	6	10	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3072	3508	811688.035	819359.502	銀合歡	Leucaena leucocephala	127	4	11	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3077	3508	811681.578	819368.778	銀合歡	Leucaena leucocephala	115	4	12	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3078	3508	811684.828	819371.903	鐵刀木	Senna siamea	155	6	10	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3086	3508	811679.779	819378.26	鐵刀木	Senna siamea	145	3	11	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3087	3508	811679.025	819379.406	銀合歡	Leucaena leucocephala	95	2	8	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3088	3508	811677.433	819380.142	銀合歡	Leucaena leucocephala	125	3	12	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3092	3508	811680.218	819381.979	鐵刀木	Senna siamea	100	2	10	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3095	3508	811677	819382.504	鐵刀木	Senna siamea	115	3	8	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3096	3508	811676.868	819384.848	銀合歡	Leucaena leucocephala	105	2	12	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3097	3508	811677.359	819385.563	銀合歡	Leucaena leucocephala	140	4	11	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3098	3508	811677.039	819385.685	鐵刀木	Senna siamea	150	3	12	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3099	3508	811675.495	819385.743	銀合歡	Leucaena leucocephala	155	5	12	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3100	3508	811674.909	819385.257	銀合歡	Leucaena leucocephala	200	5	11	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3101	3508	811676.369	819386.669	銀合歡	Leucaena leucocephala	130	6	11	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3102	3508	811684.955	819383.808	宮粉羊蹄甲	Bauhinia variegata	160	6	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3103	3508	811685.995	819383.816	宮粉羊蹄甲	Bauhinia variegata	100	6	8	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3104	3508	811688.003	819384.188	宮粉羊蹄甲	Bauhinia variegata	100	4	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3105	3508	811689.389	819386.069	苦楝	Melia azedarach	190	6	8	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3106	3508	811690.401	819385.346	黄槿	Hibiscus tiliaceus	195	5	7	FELL	MISSING	MISSING	Found missing during initial tree survey.

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3508	T3107	3508	811691.349	819384.265	銀合歡	<i>Leucaena leucocephala</i>	210	8	12	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3110	3508	811694.649	819381.586	大葉相思	<i>Acacia mangium</i>	160	3	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3111	3508	811695.983	819379.749	黃槿	<i>Hibiscus tiliaceus</i>	165	4	6	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3113	3508	811692.051	819378.333	土蜜樹	<i>Bridelia tomentosa</i>	115	4	11	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3114	3508	811695.144	819375.722	耳果相思	<i>Acacia auriculiformis</i>	140	4	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3115	3508	811694.071	819375.126	台灣相思	<i>Acacia confusa</i>	110	3	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3116	3508	811694.981	819373.865	耳果相思	<i>Acacia auriculiformis</i>	195	6	11	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3117	3508	811695.56	819375.296	苦楝	<i>Melia azedarach</i>	140	3	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3118	3508	811701.285	819374.388	黃槿	<i>Hibiscus tiliaceus</i>	275	10	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3119	3508	811703.535	819371.655	耳果相思	<i>Acacia auriculiformis</i>	150	3	8	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3120	3508	811704.365	819371.493	黃槿	<i>Hibiscus tiliaceus</i>	170	5	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3123	3508	811693.008	819375.143	台灣相思	<i>Acacia confusa</i>	105	3	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3125	3508	811687.507	819375.844	苦楝	<i>Melia azedarach</i>	150	6	11	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3126	3508	811693.996	819362.42	台灣相思	<i>Acacia confusa</i>	155	6	12	RETAIN	MISSING	MISSING	Found missing during initial tree survey.
3508	T3127	3508	811699.684	819365.162	耳果相思	<i>Acacia auriculiformis</i>	155	6	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3128	3508	811700.949	819363.14	宮粉羊蹄甲	<i>Bauhinia variegata</i>	110	6	8	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3131	3508	811709.744	819364.448	宮粉羊蹄甲	<i>Bauhinia variegata</i>	105	4	8	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3134	3508	811702.47	819367.627	苦楝	<i>Melia azedarach</i>	155	2	9	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3135	3508	811705.019	819358.753	台灣相思	<i>Acacia confusa</i>	155	4	10	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3139	3508	811708.697	819347.185	耳果相思	<i>Acacia auriculiformis</i>	145	4	9	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3140	3508	811709.652	819346.057	耳果相思	<i>Acacia auriculiformis</i>	190	4	9	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3141	3508	811709.679	819346.706	耳果相思	<i>Acacia auriculiformis</i>	170	4	9	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3142	3508	811713.061	819347.842	耳果相思	<i>Acacia auriculiformis</i>	160	6	9	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3143	3508	811710.173	819342.518	銀合歡	<i>Leucaena leucocephala</i>	155	5	9	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3144	3508	811718.086	819346.121	垂葉榕	<i>Ficus benjamina</i>	150	4	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3145	3508	811717.295	819342.701	垂葉榕	<i>Ficus benjamina</i>	180	4	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3146	3508	811716.764	819339.153	垂葉榕	<i>Ficus benjamina</i>	175	4	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3147	3508	811716.339	819334.97	垂葉榕	<i>Ficus benjamina</i>	150	4	6	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3148	3508	811716.607	819331.385	垂葉榕	<i>Ficus benjamina</i>	190	5	6	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3149	3508	811716.525	819327.908	垂葉榕	<i>Ficus benjamina</i>	165	5	6	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3153	3508	811714.424	819358.316	台灣相思	<i>Acacia confusa</i>	150	4	7	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3175	3508	811718.623	819384.506	大葉相思	<i>Acacia mangium</i>	180	1	1	FELL	FELL	FELL	Found felled by other during initial inspection from contractor.
3508	T3209	3508	811700.122	819363.654	宮粉羊蹄甲	<i>Bauhinia variegata</i>	180	8	6	FELL	MISSING	MISSING	Found missing during initial tree survey.
3508	T3220	3508	811703.234	819393.104	紅膠木	<i>Lophostemon confertus</i>	100	2	5	FELL	MISSING	MISSING	Found missing during initial tree survey.
3601	T0001	3601	810205.050	817199.955	耳果相思	<i>Acacia auriculiformis</i>	310	5	9	FELL	FELL	FELL	
3601	T0002	3601	810205.460	817196.267	木麻黃	<i>Casuarina equisetifolia</i>	110	2	8	FELL	FELL	FELL	
3601	T0003	3601	810207.955	817197.940	木麻黃	<i>Casuarina equisetifolia</i>	280	5	10	FELL	FELL	FELL	
3601	T0004	3601	810218.344	817194.593	木麻黃	<i>Casuarina equisetifolia</i>	250	4	10	FELL	FELL	FELL	
3601	T0005	3601	810215.500	817192.341	木麻黃	<i>Casuarina equisetifolia</i>	240	5	12	FELL	FELL	FELL	
3601	T0006	3601	810211.065	817189.129	木麻黃	<i>Casuarina equisetifolia</i>	420	6	10	FELL	FELL	FELL	
3601	T0007	3601	810214.387	817186.798	木麻黃	<i>Casuarina equisetifolia</i>	130	2	7	FELL	FELL	FELL	
3601	T0008	3601	810216.777	817184.108	木麻黃	<i>Casuarina equisetifolia</i>	100	2	5	FELL	FELL	FELL	
3601	T0009	3601	810212.385	817183.785	木麻黃	<i>Casuarina equisetifolia</i>	100	3	6	FELL	FELL	FELL	
3601	T0010	3601	810228.557	817186.359	木麻黃	<i>Casuarina equisetifolia</i>	200	4	7	FELL	FELL	FELL	
3601	T0011	3601	810232.458	817185.173	木麻黃	<i>Casuarina equisetifolia</i>	450	5	9	FELL	FELL	FELL	
3601	T0012	3601	810229.337	817189.036	木麻黃	<i>Casuarina equisetifolia</i>	400	7	12	FELL	FELL	FELL	
3601	T0013	3601	810230.999	817190.663	木麻黃	<i>Casuarina equisetifolia</i>	180	4	9	FELL	FELL	FELL	
3601	T0014	3601	810232.390	817192.459	木麻黃	<i>Casuarina equisetifolia</i>	160	4	9	FELL	FELL	FELL	
3602	T0001	3602	810186.657	817201.128	木麻黃	<i>Casuarina equisetifolia</i>	200	2	10	FELL	FELL	FELL	
3602	T0002	3602	810186.868	817199.781	木麻黃	<i>Casuarina equisetifolia</i>	290	7	12	FELL	FELL	FELL	
3602	T0010	3602	810181.695	817206.24	木麻黃	<i>Casuarina equisetifolia</i>	300	1	2	FELL	FELL	FELL	
3602	T0011	3602	810180.477	817207.006	台灣相思	<i>Acacia confusa</i>	150	1	1	FELL	FELL	FELL	
3602	T0012	3602	810179.159	817207.274	台灣相思	<i>Acacia confusa</i>	130	5	7	FELL	FELL	FELL	
3602	T0013	3602	810177.179	817208.138	台灣相思	<i>Acacia confusa</i>	130	5	8	FELL	FELL	FELL	
3602	T0017	3602	810175.155	817196.108	台灣相思	<i>Acacia confusa</i>	170	7	10	FELL	FELL	FELL	
3602	T0024	3602	810169.093	817197.334	台灣相思	<i>Acacia confusa</i>	220	6	8	FELL	FELL	FELL	
3602	T0035	N/A	810156.643	817202.348	大葉相思	<i>Acacia mangium Willd.</i>	300	6	9	RETAIN	Excluded from the Project	Excluded from the Project	Confirmed not locate within 3RS works area.
3602	T0036	N/A	810155.517	817203.044	大葉相思	<i>Acacia mangium Willd.</i>	450	7	12	RETAIN	Excluded from the Project	Excluded from the Project	Confirmed not locate within 3RS works area.
3602	T0039	3602	810155.564	817205.236	潺槁樹	<i>Litsea glutinosa</i>	130	4	7	FELL	FELL	FELL	
3602	T0045	3602	810154.491	817206.957	台灣相思	<i>Acacia confusa</i>	150	4	9	FELL	FELL	FELL	
3603	T0001	3603	810118.790	817215.640	木麻黃	<i>Casuarina equisetifolia</i>	300	4	12	FELL	FELL	FELL	
3603	T0002	3603	810119.320	817216.590	木麻黃	<i>Casuarina equisetifolia</i>	160	2	12	FELL	FELL	FELL	
3603	T0003	3603	810119.670	817217.600	木麻黃	<i>Casuarina equisetifolia</i>	350	6	14	FELL	FELL	FELL	
3603	T0004	3603	810118.230	817217.370	木麻黃	<i>Casuarina equisetifolia</i>	280	4	14	FELL	FELL	FELL	
3603	T0005	3603	810118.250	817219.540	台灣相思	<i>Acacia confusa</i>	140	6	10	FELL	FELL	FELL	
3603	T0006	3603	810119.500	817219.490	台灣相思	<i>Acacia confusa</i>	100	4	8	FELL	FELL	FELL	
3603	T0007	3603	810120.780	817219.460	台灣相思	<i>Acacia confusa</i>	180	4	10	FELL	FELL	FELL	
3603	T0008	3603	810121.960	817219.460	台灣相思	<i>Acacia confusa</i>	320	5	12	FELL	FELL	FELL	
3603	T0009	3603	810122.800	817220.530	台灣相思	<i>Acacia confusa</i>	220	4	10	FELL	FELL	FELL	
3603	T0010	3603	810123.750	817223.180	台灣相思	<i>Acacia confusa</i>	240	6	10	FELL	FELL	FELL	
3603	T0011	3603	810122.730	817223.150	台灣相思	<i>Acacia confusa</i>	100	2	6	FELL	FELL	FELL	
3603	T0012	3603	810121.750	817223.030	台灣相思	<i>Acacia confusa</i>	140	2	6	FELL	FELL	FELL	
3603	T0013	3603	810120.700	817223.070	台灣相思	<i>Acacia confusa</i>	110	2	6	FELL	FELL	FELL	
3603	T0014	3603	810119.880	817223.860	台灣相思	<i>Acacia confusa</i>	250	4	3	FELL	FELL	FELL	
3603	T0015	3603	810118.860	817223.720	台灣相思	<i>Acacia confusa</i>	95	2	3	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3603	T0016	3603	810116.600	817216.520	木麻黃	Casuarina equisetifolia	180	4	14	FELL	FELL	FELL	
3603	T0017	3603	810116.130	817215.340	木麻黃	Casuarina equisetifolia	240	2	9	FELL	FELL	FELL	
3603	T0018	3603	810114.700	817215.720	台灣相思	Acacia confusa	95	2	3	FELL	FELL	FELL	
3603	T0019	3603	810113.270	817216.170	台灣相思	Acacia confusa	130	4	8	FELL	FELL	FELL	
3603	T0020	3603	810111.820	817216.720	台灣相思	Acacia confusa	220	4	8	FELL	FELL	FELL	
3603	T0021	3603	810110.220	817217.320	台灣相思	Acacia confusa	130	4	8	FELL	FELL	FELL	
3603	T0022	3603	810108.500	817218.010	台灣相思	Acacia confusa	110	4	8	FELL	FELL	FELL	
3603	T0023	3603	810111.520	817223.560	木麻黃	Casuarina equisetifolia	130	2	6	FELL	FELL	FELL	
3603	T0024	3603	810112.6500	817224.7300	木麻黃	Casuarina equisetifolia	190	5	10	FELL	FELL	FELL	
3603	T0025	3603	810109.680	817224.990	木麻黃	Casuarina equisetifolia	120	4	5	FELL	FELL	FELL	
3603	T0026	3603	810107.820	817226.460	木麻黃	Casuarina equisetifolia	100	4	8	FELL	FELL	FELL	
3603	T0027	3603	810105.840	817220.800	木麻黃	Casuarina equisetifolia	120	2	8	FELL	FELL	FELL	
3603	T0028	3603	810104.720	817221.940	木麻黃	Casuarina equisetifolia	360	4	12	FELL	FELL	FELL	
3603	T0029	3603	810102.930	817221.390	木麻黃	Casuarina equisetifolia	150	4	10	FELL	FELL	FELL	
3603	T0030	3603	810103.180	817222.960	木麻黃	Casuarina equisetifolia	95	2	6	FELL	FELL	FELL	
3603	T0031	3603	810101.200	817222.690	木麻黃	Casuarina equisetifolia	95	2	5	FELL	FELL	FELL	
3603	T0032	3603	810099.260	817220.710	耳果相思	Acacia auriculiformis	200	5	8	FELL	FELL	FELL	
3603	T0033	3603	810097.520	817221.950	木麻黃	Casuarina equisetifolia	120	4	8	FELL	FELL	FELL	
3603	T0034	3603	810093.510	817224.570	台灣相思	Acacia confusa	300	8	7	FELL	FELL	FELL	
3603	T0035	3603	810089.380	817223.780	朴樹	Celtis sinensis	120	3	7	FELL	FELL	FELL	
3603	T0036	3603	810087.450	817224.160	木麻黃	Casuarina equisetifolia	350	6	12	FELL	FELL	FELL	
3603	T0037	3603	810085.730	817224.500	木麻黃	Casuarina equisetifolia	220	4	12	FELL	FELL	FELL	
3603	T0038	3603	810083.860	817224.980	木麻黃	Casuarina equisetifolia	140	4	12	FELL	FELL	FELL	
3603	T0039	3603	810082.510	817225.460	木麻黃	Casuarina equisetifolia	95	2	3	FELL	FELL	FELL	
3603	T0040	3603	810084.300	817228.720	木麻黃	Casuarina equisetifolia	120	4	12	FELL	FELL	FELL	
3603	T0041	3603	810087.590	817227.180	木麻黃	Casuarina equisetifolia	140	4	8	FELL	FELL	FELL	
3603	T0042	3603	810088.640	817228.040	木麻黃	Casuarina equisetifolia	140	4	8	FELL	FELL	FELL	
3603	T0043	3603	810087.590	817228.760	木麻黃	Casuarina equisetifolia	200	5	14	FELL	FELL	FELL	
3603	T0044	3603	810089.840	817233.090	耳果相思	Acacia auriculiformis	180	3	5	FELL	FELL	FELL	
3603	T0045	3603	810088.540	817234.610	木麻黃	Casuarina equisetifolia	140	4	10	FELL	FELL	FELL	
3603	T0046	3603	810087.270	817235.070	木麻黃	Casuarina equisetifolia	140	2	8	FELL	FELL	FELL	
3603	T0047	3603	810085.680	817234.700	木麻黃	Casuarina equisetifolia	190	4	8	FELL	FELL	FELL	
3603	T0048	3603	810084.710	817235.790	木麻黃	Casuarina equisetifolia	180	4	10	FELL	FELL	FELL	
3603	T0049	3603	810083.440	817236.080	木麻黃	Casuarina equisetifolia	180	4	12	FELL	FELL	FELL	
3603	T0050	3603	810082.060	817235.100	台灣相思	Acacia confusa	100	4	5	FELL	FELL	FELL	
3603	T0051	3603	810080.580	817235.560	台灣相思	Acacia confusa	100	2	4	FELL	FELL	FELL	
3603	T0052	3603	810078.510	817236.920	台灣相思	Acacia confusa	100	2	3	FELL	FELL	FELL	
3603	T0053	3603	810078.540	817233.440	台灣相思	Acacia confusa	150	4	6	FELL	FELL	FELL	
3603	T0054	3603	810077.740	817232.670	台灣相思	Acacia confusa	220	4	8	FELL	FELL	FELL	
3603	T0055	3603	810077.090	817231.690	台灣相思	Acacia confusa	95	2	4	FELL	FELL	FELL	
3603	T0056	3603	810075.810	817232.260	台灣相思	Acacia confusa	140	4	7	FELL	FELL	FELL	
3603	T0057	3603	810077.380	817236.770	台灣相思	Acacia confusa	120	4	6	FELL	FELL	FELL	
3603	T0058	3603	810076.280	817236.780	台灣相思	Acacia confusa	95	2	4	FELL	FELL	FELL	
3603	T0059	3603	810075.310	817237.510	台灣相思	Acacia confusa	95	2	3	FELL	FELL	FELL	
3603	T0060	3603	810075.000	817235.020	耳果相思	Acacia auriculiformis	110	2	8	FELL	FELL	FELL	
3603	T0061	3603	810074.260	817238.480	木麻黃	Casuarina equisetifolia	160	4	12	FELL	FELL	FELL	
3603	T0062	3603	810075.230	817239.370	木麻黃	Casuarina equisetifolia	300	5	14	FELL	FELL	FELL	
3603	T0063	3603	810073.800	817239.730	木麻黃	Casuarina equisetifolia	180	4	12	FELL	FELL	FELL	
3603	T0064	3603	810072.440	817240.290	木麻黃	Casuarina equisetifolia	180	4	12	FELL	FELL	FELL	
3603	T0065	3603	810072.360	817239.080	木麻黃	Casuarina equisetifolia	180	4	10	FELL	FELL	FELL	
3603	T0066	3603	810070.180	817237.990	台灣相思	Acacia confusa	95	1	3	FELL	FELL	FELL	
3603	T0067	3603	810069.040	817237.080	台灣相思	Acacia confusa	95	1	2	FELL	FELL	FELL	
3603	T0068	3603	810067.520	817234.480	木麻黃	Casuarina equisetifolia	140	4	12	FELL	FELL	FELL	
3603	T0069	3603	810066.920	817235.680	木麻黃	Casuarina equisetifolia	220	4	14	FELL	FELL	FELL	
3603	T0070	3603	810065.880	817234.540	木麻黃	Casuarina equisetifolia	220	4	14	FELL	FELL	FELL	
3728	T2	3728	810950.9776	817585.7448	銀合歡	Leucaena leucocephala	231	4	9	*	FELL	FELL	
3728	T3	3728	810943.5751	817597.863	桑樹	Morus alba	422	6	8	*	FELL	FELL	
3728	T4	3728	810945.9721	817585.3292	銀合歡	Leucaena leucocephala	120	6	7	*	FELL	FELL	
3728	T5	3728	810941.1552	817587.5835	銀合歡	Leucaena leucocephala	148	4	8	*	FELL	FELL	
3728	T6	3728	810933.7211	817586.5055	銀合歡	Leucaena leucocephala	120	3	8	*	FELL	FELL	
3728	T7	3728	810937.5229	817591.1759	銀合歡	Leucaena leucocephala	120	3	2	*	FELL	FELL	
3728	T8	3728	810936.8808	817595.2206	銀合歡	Leucaena leucocephala	130	4	8	*	FELL	FELL	
3728	T9	3728	810930.2059	817592.6487	銀合歡	Leucaena leucocephala	125	4	6	*	FELL	FELL	
3728	T10	3728	810926.3525	817590.1991	銀合歡	Leucaena leucocephala	116	4	3	*	FELL	FELL	
3728	T11	3728	810932.0438	817581.0358	銀合歡	Leucaena leucocephala	115	5	8	*	FELL	FELL	
3728	T12	3728	810922.4458	817584.5594	苦楝	Melia azedarach	316	7	11	*	FELL	FELL	
3728	T13	3728	810928.7337	817578.2439	銀合歡	Leucaena leucocephala	354	9	11	*	FELL	FELL	
3728	T14	3728	810918.485	817579.8364	銀合歡	Leucaena leucocephala	171	6	9	*	FELL	FELL	
3728	T15	3728	810917.8134	817576.1966	銀合歡	Leucaena leucocephala	225	6	9	*	FELL	FELL	
3728	T16	3728	810917.5586	817573.5636	銀合歡	Leucaena leucocephala	110	3	7	*	FELL	FELL	
3728	T17	3728	810914.599	817579.5789	銀合歡	Leucaena leucocephala	130	2	4	*	FELL	FELL	
3728	T18	3728	810911.7809	817579.0712	銀合歡	Leucaena leucocephala	115	2	4	*	FELL	FELL	
3728	T19	3728	810907.9505	817578.5835	銀合歡	Leucaena leucocephala	210	1	2	*	FELL	FELL	
3728	T20	3728	810885.4935	817576.2373	銀合歡	Leucaena leucocephala	302	6	8	*	FELL	FELL	
3728	T21	3728	810892.3586	817561.2137	銀合歡	Leucaena leucocephala	115	4	8	*	FELL	FELL	
3728	T22	3728	810891.9891	817552.3865	苦楝	Melia azedarach	430	9	12	*	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3728	T23	3728	810895.1096	817551.9523	苦楝	Melia azedarach	260	6	12	*	FELL	FELL	
3728	T24	3728	810890.4506	817544.1072	銀合歡	Leucaena leucocephala	108	4	8	*	FELL	FELL	
3728	T25	3728	810898.6919	817543.823	銀合歡	Leucaena leucocephala	103	4	8	*	FELL	FELL	
3728	T26	3728	810894.559	817539.3592	苦楝	Melia azedarach	250	6	11	*	FELL	FELL	
3728	T27	3728	810901.9867	817539.7597	苦楝	Melia azedarach	128	4	9	*	FELL	FELL	
3728	T28	3728	810899.3525	817536.9166	苦楝	Melia azedarach	125	3	9	*	FELL	FELL	
3728	T29	3728	810899.4588	817531.8931	銀合歡	Leucaena leucocephala	112	5	9	*	FELL	FELL	
3728	T30	3728	810898.8224	817526.3778	銀合歡	Leucaena leucocephala	260	6	11	*	FELL	FELL	
3728	T31	3728	810906.4992	817531.296	苦楝	Melia azedarach	346	6	11	*	FELL	FELL	
3728	T32	3728	810909.7422	817536.112	銀合歡	Leucaena leucocephala	165	3	6	*	FELL	FELL	
3728	T33	3728	810913.9869	817533.9101	苦楝	Melia azedarach	152	3	11	*	FELL	FELL	
3728	T34	3728	810920.9961	817538.4257	苦楝	Melia azedarach	224	4	11	*	FELL	FELL	
3728	T35	3728	810910.791	817542.6334	銀合歡	Leucaena leucocephala	160	4	9	*	FELL	FELL	
3728	T36	3728	810927.2314	817538.213	苦楝	Melia azedarach	224	3	9	*	FELL	FELL	
3728	T37	3728	810937.9227	817547.963	苦楝	Melia azedarach	485	6	11	*	FELL	FELL	
3728	T38	3728	810941.1474	817545.1523	苦楝	Melia azedarach	280	4	10	*	FELL	FELL	
3728	T39	3728	810942.9451	817548.5522	銀合歡	Leucaena leucocephala	181	3	7	*	FELL	FELL	
3728	T40	3728	810941.1494	817552.2427	死樹	Dead Tree	170	1	1	*	FELL	FELL	
3728	T41	3728	810942.5078	817560.8958	銀合歡	Leucaena leucocephala	200	2	9	*	FELL	FELL	
3728	T42	3728	810945.1225	817560.6361	銀合歡	Leucaena leucocephala	125	4	9	*	FELL	FELL	
3728	T43	3728	810947.353	817560.2992	銀合歡	Leucaena leucocephala	180	4	9	*	FELL	FELL	
3728	T44	3728	810951.2471	817564.1559	苦楝	Melia azedarach	195	4	8	*	FELL	FELL	
3728	T45	3728	810952.7511	817560.8097	銀合歡	Leucaena leucocephala	155	4	8	*	FELL	FELL	
3728	T46	3728	810951.5962	817547.2889	銀合歡	Leucaena leucocephala	112	4	7	*	FELL	FELL	
3728	T47	3728	810957.0422	817548.7489	銀合歡	Leucaena leucocephala	118	2	7	*	FELL	FELL	
3728	T48	3728	810962.6143	817550.4222	銀合歡	Leucaena leucocephala	105	2	7	*	FELL	FELL	
3728	T49	3728	810960.1829	817562.4621	銀合歡	Leucaena leucocephala	140	5	6	*	FELL	FELL	
3728	T50	3728	810956.3763	817569.1987	銀合歡	Leucaena leucocephala	120	5	1	*	FELL	FELL	
3728	T51	3728	810953.9204	817570.7445	銀合歡	Leucaena leucocephala	120	4	8	*	FELL	FELL	
3728	T52	3728	810951.6212	817567.9158	銀合歡	Leucaena leucocephala	120	4	8	*	FELL	FELL	
3728	T53	3728	810934.5443	817572.5227	苦楝	Melia azedarach	150	4	8	*	FELL	FELL	
3728	T54	3728	810937.9896	817568.9962	銀合歡	Leucaena leucocephala	128	4	2	*	FELL	FELL	
3728	T55	3728	810931.9406	817569.193	銀合歡	Leucaena leucocephala	190	5	8	*	FELL	FELL	
3728	T56	3728	810933.9416	817565.69	台灣相思	Acacia confusa	255	6	9	*	FELL	FELL	
3728	T57	3728	810929.9804	817551.5172	死樹	Dead Tree	635	6	1	*	FELL	FELL	
3728	T58	3728	810925.6542	817553.3724	台灣相思	Acacia confusa	214	5	6	*	FELL	FELL	
3728	T59	3728	810927.8348	817546.2148	銀合歡	Leucaena leucocephala	97	4	7	*	FELL	FELL	
3728	T60	3728	810924.0461	817549.1364	銀合歡	Leucaena leucocephala	158	4	7	*	FELL	FELL	
3728	T61	3728	810905.4531	817549.389	銀合歡	Leucaena leucocephala	191	9	8	*	FELL	FELL	
3728	T62	3728	810906.0465	817545.2812	銀合歡	Leucaena leucocephala	140	2	4	*	FELL	FELL	
3728	T63	3728	810919.6579	817559.2558	銀合歡	Leucaena leucocephala	105	4	8	*	FELL	FELL	
3728	T64	3728	810928.297	817572.6426	銀合歡	Leucaena leucocephala	159	8	8	*	FELL	FELL	
3728	T65	3728	810953.8519	817574.9112	銀合歡	Leucaena leucocephala	140	2	4	*	FELL	FELL	
3728	T66	3728	810951.252	817578.575	銀合歡	Leucaena leucocephala	130	6	8	*	FELL	FELL	
3728	T67	3728	810948.0651	817581.1369	銀合歡	Leucaena leucocephala	177	6	7	*	FELL	FELL	
3728	T68	3728	810761.011	817525.228	銀合歡	Leucaena leucocephala	115	5	7	*	FELL	FELL	
3728	T69	3728	810756.935	817524.644	銀合歡	Leucaena leucocephala	145	6	7	*	FELL	FELL	
3728	T70	3728	810754.754	817524.141	銀合歡	Leucaena leucocephala	105	6	7	*	FELL	FELL	
3728	T71	3728	810752.983	817523.759	銀合歡	Leucaena leucocephala	145	3	4	*	FELL	FELL	
3728	T72	3728	810749.067	817522.550	銀合歡	Leucaena leucocephala	165	5	7	*	FELL	FELL	
3728	T73	3728	810744.724	817521.199	銀合歡	Leucaena leucocephala	185	5	7	*	FELL	FELL	
3728	T74	3728	810745.409	817516.329	銀合歡	Leucaena leucocephala	125	5	6	*	FELL	FELL	
3728	T75	3728	810742.728	817515.565	銀合歡	Leucaena leucocephala	119	4	9	*	FELL	FELL	
3728	T76	3728	810739.095	817519.031	銀合歡	Leucaena leucocephala	100	4	6	*	FELL	FELL	
3728	T77	3728	810736.576	817518.080	苦楝	Melia azedarach	117	5	6	*	FELL	FELL	
3728	T78	3728	810732.543	817516.819	銀合歡	Leucaena leucocephala	113	4	7	*	FELL	FELL	
3728	T79	3728	810728.804	817515.445	銀合歡	Leucaena leucocephala	143	5	7	*	FELL	FELL	
3801	T1462	3508	811455.842	820110.939	大葉相思	Acacia mangium	290	7	12	FELL	REMOVED	REMOVED	
3801	T1463	3508	811457.807	820109.919	大葉相思	Acacia mangium	300	5	12	RETAIN	REMOVED	REMOVED	
3801	T1464	3508	811458.701	820109.731	台灣相思	Acacia confusa	120	5	10	RETAIN	REMOVED	REMOVED	
3801	T1466	3508	811461.003	820109.928	台灣相思	Acacia confusa	120	4	10	RETAIN	REMOVED	REMOVED	
3801	T1467	3508	811459.548	820109.118	台灣相思	Acacia confusa	170	5	8	RETAIN	REMOVED	REMOVED	
3801	CT100	3801	811708.059	820136.975	銀合歡	Leucaena leucocephala	170	8	12	FELL	FELL	FELL	
3801	CT1000	3801	811607.372	820089.480	羊蹄甲屬	Bauhinia spp.	130	6	9	FELL	FELL	FELL	
3801	CT1001	3801	811606.424	820089.670	紅膠木	Lophostemon confertus	170	5	10	FELL	FELL	FELL	
3801	CT1002	3801	811609.506	820095.199	苦楝	Melia azedarach	300	9	13	FELL	FELL	FELL	
3801	CT1003	3801	811607.877	820095.079	羊蹄甲屬	Bauhinia spp.	110	4	6	FELL	FELL	FELL	
3801	CT1004	3801	811604.373	820092.891	台灣相思	Acacia confusa	200	7	11	FELL	FELL	FELL	
3801	CT1005	3801	811603.943	820091.949	台灣相思	Acacia confusa	160	5	11	FELL	FELL	FELL	
3801	CT1006	3801	811603.128	820090.076	台灣相思	Acacia confusa	286	9	14	FELL	FELL	FELL	
3801	CT1007	3801	811603.031	820091.028	台灣相思	Acacia confusa	150	4	10	FELL	FELL	FELL	
3801	CT1008	3801	811600.940	820091.174	台灣相思	Acacia confusa	140	5	11	FELL	FELL	FELL	
3801	CT1009	3801	811601.456	820091.886	台灣相思	Acacia confusa	110	5	11	FELL	FELL	FELL	
3801	CT101	3801	811709.156	820139.805	銀合歡	Leucaena leucocephala	130	6	11	FELL	FELL	FELL	
3801	CT1010	3801	811600.653	820092.141	台灣相思	Acacia confusa	110	4	10	FELL	FELL	FELL	
3801	CT1011	3801	811601.135	820093.077	台灣相思	Acacia confusa	240	7	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1012	3801	811601.878	820095.769	黃槿	Hibiscus tiliaceus	225	8	9	FELL	FELL	FELL	
3801	CT1013	3801	811599.434	820095.420	大葉相思	Acacia mangium	190	5	11	FELL	FELL	FELL	
3801	CT1014	3801	811598.990	820091.664	羊蹄甲屬	Bauhinia spp.	270	7	10	FELL	FELL	FELL	
3801	CT1015	3801	811595.349	820090.995	大葉相思	Acacia mangium	220	6	13	FELL	FELL	FELL	
3801	CT1016	3801	811593.924	820091.210	大葉相思	Acacia mangium	220	5	10	FELL	FELL	FELL	
3801	CT1017	3801	811594.438	820091.634	大葉相思	Acacia mangium	270	6	12	FELL	FELL	FELL	
3801	CT1018	3801	811594.056	820092.363	大葉相思	Acacia mangium	250	6	12	FELL	FELL	FELL	
3801	CT1019	3801	811594.678	820094.767	台灣相思	Acacia confusa	160	6	11	FELL	FELL	FELL	
3801	CT102	3801	811704.726	820142.180	台灣相思	Acacia confusa	150	6	10	FELL	FELL	FELL	
3801	CT1020	3801	811593.529	820095.048	台灣相思	Acacia confusa	100	5	6	FELL	FELL	FELL	
3801	CT1021	3801	811592.600	820095.118	台灣相思	Acacia confusa	110	6	8	FELL	FELL	FELL	
3801	CT1022	3801	811591.996	820093.947	台灣相思	Acacia confusa	130	6	6	FELL	FELL	FELL	
3801	CT1023	3801	811591.141	820093.820	台灣相思	Acacia confusa	200	7	11	FELL	FELL	FELL	
3801	CT1024	3801	811590.773	820092.600	台灣相思	Acacia confusa	140	6	8	FELL	FELL	FELL	
3801	CT1025	3801	811587.510	820091.877	苦楝	Melia azedarach	330	7	12	FELL	FELL	FELL	
3801	CT1026	3801	811586.993	820091.341	台灣相思	Acacia confusa	130	7	6	FELL	FELL	FELL	
3801	CT1027	3801	811585.559	820091.233	台灣相思	Acacia confusa	320	8	11	FELL	FELL	FELL	
3801	CT1028	3801	811585.686	820092.992	大葉相思	Acacia mangium	270	7	12	FELL	FELL	FELL	
3801	CT1029	3801	811585.350	820094.412	大葉相思	Acacia mangium	260	6	10	FELL	FELL	FELL	
3801	CT103	3801	811702.715	820142.816	台灣相思	Acacia confusa	140	7	12	FELL	FELL	FELL	
3801	CT1030	3801	811583.754	820092.969	苦楝	Melia azedarach	210	6	11	FELL	FELL	FELL	
3801	CT1031	3801	811583.108	820096.896	台灣相思	Acacia confusa	120	4	5	FELL	FELL	FELL	
3801	CT1032	3801	811581.253	820091.932	紅膠木	Lophostemon confertus	180	5	10	FELL	FELL	FELL	
3801	CT1033	3801	811580.528	820092.523	大葉相思	Acacia mangium	100	4	8	FELL	FELL	FELL	
3801	CT1034	3801	811577.009	820091.211	羊蹄甲屬	Bauhinia spp.	100	6	6	FELL	FELL	FELL	
3801	CT1035	3801	811576.435	820092.461	台灣相思	Acacia confusa	150	7	6	FELL	FELL	FELL	
3801	CT1036	3801	811575.761	820090.461	羊蹄甲屬	Bauhinia spp.	170	9	11	FELL	FELL	FELL	
3801	CT1037	3801	811576.526	820093.358	大葉相思	Acacia mangium	280	9	11	FELL	FELL	FELL	
3801	CT1038	3801	811575.973	820093.172	台灣相思	Acacia confusa	110	7	7	FELL	FELL	FELL	
3801	CT1039	3801	811575.124	820093.899	台灣相思	Acacia confusa	110	6	8	FELL	FELL	FELL	
3801	CT104	3801	811701.026	820144.182	台灣相思	Acacia confusa	120	7	11	FELL	FELL	FELL	
3801	CT1040	3801	811574.214	820093.757	台灣相思	Acacia confusa	205	6	11	FELL	FELL	FELL	
3801	CT1041	3801	811574.478	820092.307	台灣相思	Acacia confusa	150	6	8	FELL	FELL	FELL	
3801	CT1042	3801	811573.330	820091.987	台灣相思	Acacia confusa	130	5	8	FELL	FELL	FELL	
3801	CT1043	3801	811572.789	820095.282	紅膠木	Lophostemon confertus	100	3	5	FELL	FELL	FELL	
3801	CT1044	3801	811571.245	820095.114	紅膠木	Lophostemon confertus	195	5	12	FELL	FELL	FELL	
3801	CT1045	3801	811568.545	820094.611	苦楝	Melia azedarach	280	10	12	FELL	FELL	FELL	
3801	CT1046	3801	811566.727	820093.252	紅膠木	Lophostemon confertus	230	5	10	FELL	FELL	FELL	
3801	CT1047	3801	811568.953	820091.315	苦楝	Melia azedarach	160	7	11	FELL	FELL	FELL	
3801	CT1048	3801	811568.353	820091.045	紅膠木	Lophostemon confertus	110	4	10	FELL	FELL	FELL	
3801	CT1049	3801	811567.019	820089.853	死樹	Dead tree	100	2	6	FELL	FELL	FELL	
3801	CT105	3801	811699.745	820145.874	台灣相思	Acacia confusa	110	6	10	FELL	FELL	FELL	
3801	CT1050	3801	811566.127	820091.444	羊蹄甲屬	Bauhinia spp.	130	5	10	FELL	FELL	FELL	
3801	CT1051	3801	811565.009	820089.141	大葉相思	Acacia mangium	180	4	11	FELL	FELL	FELL	
3801	CT1052	3801	811564.049	820090.051	羊蹄甲屬	Bauhinia spp.	190	6	11	FELL	FELL	FELL	
3801	CT1053	3801	811563.228	820088.533	台灣相思	Acacia confusa	160	5	10	FELL	FELL	FELL	
3801	CT1054	3801	811562.323	820088.771	台灣相思	Acacia confusa	190	6	9	FELL	FELL	FELL	
3801	CT1055	3801	811561.331	820088.018	台灣相思	Acacia confusa	120	4	10	FELL	FELL	FELL	
3801	CT1056	3801	811561.552	820087.052	台灣相思	Acacia confusa	120	3	10	FELL	FELL	FELL	
3801	CT1057	3801	811564.132	820087.086	台灣相思	Acacia confusa	160	6	10	FELL	FELL	FELL	
3801	CT1058	3801	811561.629	820085.749	台灣相思	Acacia confusa	150	5	11	FELL	FELL	FELL	
3801	CT1059	3801	811559.710	820086.199	黃槿	Hibiscus tiliaceus	180	4	8	FELL	FELL	FELL	
3801	CT106	3801	811699.102	820145.128	台灣相思	Acacia confusa	100	5	9	FELL	FELL	FELL	
3801	CT1060	3801	811560.023	820085.072	黃槿	Hibiscus tiliaceus	180	5	10	FELL	FELL	FELL	
3801	CT1061	3801	811559.064	820085.206	黃槿	Hibiscus tiliaceus	180	6	10	FELL	FELL	FELL	
3801	CT1062	3801	811559.525	820084.247	黃槿	Hibiscus tiliaceus	130	5	10	FELL	FELL	FELL	
3801	CT1063	3801	811559.921	820084.002	黃槿	Hibiscus tiliaceus	150	5	11	FELL	FELL	FELL	
3801	CT1064	3801	811559.676	820083.576	死樹	Dead tree	190	4	10	FELL	FELL	FELL	
3801	CT1065	3801	811557.779	820082.453	紅膠木	Lophostemon confertus	130	4	10	FELL	FELL	FELL	
3801	CT1066	3801	811559.947	820081.485	羊蹄甲屬	Bauhinia spp.	180	8	10	FELL	FELL	FELL	
3801	CT1067	3801	811560.620	820080.298	羊蹄甲屬	Bauhinia spp.	110	6	6	FELL	FELL	FELL	
3801	CT1068	3801	811559.103	820079.650	死樹	Dead tree	110	5	7	FELL	FELL	FELL	
3801	CT1069	3801	811557.033	820074.486	大葉合歡	Albizia lebbeck	150	5	6	FELL	FELL	FELL	
3801	CT107	3801	811699.198	820146.775	台灣相思	Acacia confusa	130	7	10	FELL	FELL	FELL	
3801	CT1070	3801	811555.169	820069.753	黃槿	Hibiscus tiliaceus	110	5	5	FELL	FELL	FELL	
3801	CT1071	3801	811555.400	820068.590	黃槿	Hibiscus tiliaceus	110	7	6	FELL	FELL	FELL	
3801	CT1072	3801	811555.341	820068.535	黃槿	Hibiscus tiliaceus	100	4	8	FELL	FELL	FELL	
3801	CT1073	3801	811553.969	820067.809	黃槿	Hibiscus tiliaceus	160	4	7	FELL	FELL	FELL	
3801	CT1074	3801	811551.642	820068.428	羊蹄甲屬	Bauhinia spp.	130	3	6	FELL	FELL	FELL	
3801	CT1075	3801	811550.499	820068.186	羊蹄甲屬	Bauhinia spp.	110	3	6	FELL	FELL	FELL	
3801	CT1076	3801	811552.339	820064.925	黃槿	Hibiscus tiliaceus	180	5	8	FELL	FELL	FELL	
3801	CT1077	3801	811551.714	820064.022	黃槿	Hibiscus tiliaceus	100	2	7	FELL	FELL	FELL	
3801	CT1078	3801	811552.751	820064.019	黃槿	Hibiscus tiliaceus	120	5	7	FELL	FELL	FELL	
3801	CT1079	3801	811553.933	820064.056	黃槿	Hibiscus tiliaceus	230	7	10	FELL	FELL	FELL	
3801	CT108	3801	811695.784	820145.940	銀合歡	Leucaena leucocephala	122	7	11	FELL	FELL	FELL	
3801	CT1080	3801	811553.922	820063.035	黃槿	Hibiscus tiliaceus	170	10	10	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1081	3801	811553.631	820062.288	黃槿	Hibiscus tiliaceus	170	6	10	FELL	FELL	FELL	
3801	CT1082	3801	811552.391	820062.737	黃槿	Hibiscus tiliaceus	150	7	10	FELL	FELL	FELL	
3801	CT1083	3801	811551.511	820061.720	台灣相思	Acacia confusa	150	5	10	FELL	FELL	FELL	
3801	CT1084	3801	811551.307	820062.904	黃槿	Hibiscus tiliaceus	130	5	9	FELL	FELL	FELL	
3801	CT1085	3801	811549.398	820063.355	黃槿	Hibiscus tiliaceus	140	6	8	FELL	FELL	FELL	
3801	CT1086	3801	811549.346	820064.416	羊蹄甲屬	Bauhinia spp.	100	5	6	FELL	FELL	FELL	
3801	CT1087	3801	811555.660	820057.850	羊蹄甲屬	Bauhinia spp.	120	6	7	FELL	FELL	FELL	
3801	CT1088	3801	811548.880	820057.057	台灣相思	Acacia confusa	150	6	10	FELL	FELL	FELL	
3801	CT1089	3801	811548.236	820055.579	黃槿	Hibiscus tiliaceus	130	7	9	FELL	FELL	FELL	
3801	CT109	3801	811705.843	820144.767	台灣相思	Acacia confusa	120	9	8	FELL	FELL	FELL	
3801	CT1090	3801	811547.480	820056.281	黃槿	Hibiscus tiliaceus	220	9	8	FELL	FELL	FELL	
3801	CT1091	3801	811547.944	820054.095	黃槿	Hibiscus tiliaceus	130	6	9	FELL	FELL	FELL	
3801	CT1092	3801	811547.965	820053.037	黃槿	Hibiscus tiliaceus	170	6	9	FELL	FELL	FELL	
3801	CT1093	3801	811546.709	820054.670	黃槿	Hibiscus tiliaceus	120	6	9	FELL	FELL	FELL	
3801	CT1094	3801	811545.351	820054.741	黃槿	Hibiscus tiliaceus	180	8	8	FELL	FELL	FELL	
3801	CT1095	3801	811544.148	820054.496	黃槿	Hibiscus tiliaceus	270	10	9	FELL	FELL	FELL	
3801	CT1096	3801	811545.917	820053.257	黃槿	Hibiscus tiliaceus	120	4	5	FELL	FELL	FELL	
3801	CT1097	3801	811549.236	820052.378	台灣相思	Acacia confusa	190	5	10	FELL	FELL	FELL	
3801	CT1098	3801	811549.193	820051.175	黃花夾竹桃	Thevetia peruviana	110	4	5	FELL	FELL	FELL	
3801	CT1099	3801	811551.200	820051.622	台灣相思	Acacia confusa	110	5	9	FELL	FELL	FELL	
3801	CT110	3801	811706.547	820144.347	台灣相思	Acacia confusa	140	6	6	FELL	FELL	FELL	
3801	CT1100	3801	811554.902	820054.938	羊蹄甲屬	Bauhinia spp.	190	7	9	FELL	FELL	FELL	
3801	CT1101	3801	811551.836	820050.553	台灣相思	Acacia confusa	190	4	7	FELL	FELL	FELL	
3801	CT1102	3801	811551.922	820049.473	台灣相思	Acacia confusa	170	5	6	FELL	FELL	FELL	
3801	CT1103	3801	811559.421	820044.326	羊蹄甲屬	Bauhinia spp.	220	6	8	FELL	FELL	FELL	
3801	CT1104	3801	811559.250	820046.366	苦楝	Melia azedarach	600	10	13	FELL	FELL	FELL	
3801	CT1105	3801	811565.195	820043.652	大葉相思	Acacia mangium	290	8	13	FELL	FELL	FELL	
3801	CT1106	3801	811566.393	820042.044	黃槿	Hibiscus tiliaceus	290	8	10	FELL	FELL	FELL	
3801	CT1107	3801	811567.495	820042.292	黃槿	Hibiscus tiliaceus	130	7	7	FELL	FELL	FELL	
3801	CT1108	3801	811568.062	820041.905	黃槿	Hibiscus tiliaceus	150	5	11	FELL	FELL	FELL	
3801	CT1109	3801	811568.775	820041.524	黃槿	Hibiscus tiliaceus	150	6	10	FELL	FELL	FELL	
3801	CT111	3801	811710.312	820144.229	銀合歡	Leucaena leucocephala	120	6	14	FELL	FELL	FELL	
3801	CT1110	3801	811571.069	820040.143	台灣相思	Acacia confusa	260	8	15	FELL	FELL	FELL	
3801	CT1111	3801	811571.879	820039.158	台灣相思	Acacia confusa	150	4	5	FELL	FELL	FELL	
3801	CT1112	3801	811572.832	820038.796	台灣相思	Acacia confusa	180	7	7	FELL	FELL	FELL	
3801	CT1113	3801	811574.389	820038.694	羊蹄甲屬	Bauhinia spp.	120	6	7	FELL	FELL	FELL	
3801	CT1114	3801	811575.194	820037.855	大葉相思	Acacia mangium	240	5	15	FELL	FELL	FELL	
3801	CT1115	3801	811576.128	820037.145	大葉相思	Acacia mangium	300	6	15	FELL	FELL	FELL	
3801	CT1116	3801	811576.837	820037.461	大葉相思	Acacia mangium	180	4	14	FELL	FELL	FELL	
3801	CT1117	3801	811578.856	820036.349	大葉相思	Acacia mangium	350	10	15	FELL	FELL	FELL	
3801	CT1118	3801	811581.254	820035.240	大葉相思	Acacia mangium	320	6	12	FELL	FELL	FELL	
3801	CT1119	3801	811581.266	820034.378	台灣相思	Acacia confusa	140	6	7	FELL	FELL	FELL	
3801	CT112	3801	811709.264	820144.397	銀合歡	Leucaena leucocephala	130	7	13	FELL	FELL	FELL	
3801	CT1120	3801	811582.400	820034.075	台灣相思	Acacia confusa	120	5	5	FELL	FELL	FELL	
3801	CT1121	3801	811585.549	820033.011	台灣相思	Acacia confusa	180	7	8	FELL	FELL	FELL	
3801	CT1122	3801	811586.315	820032.910	台灣相思	Acacia confusa	130	4	10	FELL	FELL	FELL	
3801	CT1123	3801	811587.468	820033.300	台灣相思	Acacia confusa	150	5	10	FELL	FELL	FELL	
3801	CT1124	3801	811587.897	820032.460	台灣相思	Acacia confusa	260	7	14	FELL	FELL	FELL	
3801	CT1125	3801	811593.367	820031.377	台灣相思	Acacia confusa	160	6	7	FELL	FELL	FELL	
3801	CT1126	3801	811594.803	820030.913	台灣相思	Acacia confusa	200	7	8	FELL	FELL	FELL	
3801	CT1127	3801	811598.796	820029.958	大葉相思	Acacia mangium	310	8	14	FELL	FELL	FELL	
3801	CT1128	3801	811599.528	820029.759	大葉相思	Acacia mangium	250	7	12	FELL	FELL	FELL	
3801	CT1129	3801	811608.477	820029.014	濕地松	Pinus elliotii	100	3	5	FELL	FELL	FELL	
3801	CT113	3801	811709.039	820146.496	台灣相思	Acacia confusa	130	7	9	FELL	FELL	FELL	
3801	CT1130	3801	811609.126	820028.329	濕地松	Pinus elliotii	140	4	10	FELL	FELL	FELL	
3801	CT1131	3801	811616.238	820030.840	台灣相思	Acacia confusa	140	7	7	FELL	FELL	FELL	
3801	CT1132	3801	811616.308	820031.851	台灣相思	Acacia confusa	190	6	10	FELL	FELL	FELL	
3801	CT1133	3801	811615.852	820033.203	台灣相思	Acacia confusa	220	8	13	FELL	FELL	FELL	
3801	CT1134	3801	811616.563	820034.090	台灣相思	Acacia confusa	240	8	15	FELL	FELL	FELL	
3801	CT1135	3801	811617.394	820032.983	台灣相思	Acacia confusa	170	6	11	FELL	FELL	FELL	
3801	CT1136	3801	811618.703	820033.940	台灣相思	Acacia confusa	130	4	12	FELL	FELL	FELL	
3801	CT1137	3801	811618.532	820032.164	台灣相思	Acacia confusa	240	7	15	FELL	FELL	FELL	
3801	CT1138	3801	811618.342	820030.837	死樹	Dead tree	140	5	8	FELL	FELL	FELL	
3801	CT1139	3801	811623.664	820032.115	黃槿	Hibiscus tiliaceus	100	4	6	FELL	FELL	FELL	
3801	CT114	3801	811707.566	820147.036	台灣相思	Acacia confusa	120	6	8	FELL	FELL	FELL	
3801	CT1141	3801	811626.059	820031.226	苦楝	Melia azedarach	350	10	16	FELL	FELL	FELL	
3801	CT1142	3801	811619.670	820038.156	大葉相思	Acacia mangium	154	4	9	FELL	FELL	FELL	
3801	CT1143	3801	811620.477	820039.727	大葉相思	Acacia mangium	250	4	15	FELL	FELL	FELL	
3801	CT1144	3801	811621.862	820039.024	大葉相思	Acacia mangium	110	2	7	FELL	FELL	FELL	
3801	CT1145	3801	811621.406	820040.377	大葉相思	Acacia mangium	140	3	14	FELL	FELL	FELL	
3801	CT1146	3801	811621.669	820040.969	大葉相思	Acacia mangium	220	4	15	FELL	FELL	FELL	
3801	CT1149	3801	811619.755	820042.274	台灣相思	Acacia confusa	370	7	11	FELL	FELL	FELL	
3801	CT115	3801	811707.393	820147.792	台灣相思	Acacia confusa	120	9	6	FELL	FELL	FELL	
3801	CT1152	3801	811618.639	820047.981	羊蹄甲屬	Bauhinia spp.	110	5	7	FELL	FELL	FELL	
3801	CT1154	3801	811622.603	820042.126	苦楝	Melia azedarach	270	8	16	FELL	FELL	FELL	
3801	CT1155	3801	811624.929	820047.806	苦楝	Melia azedarach	350	7	16	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1156	3801	811626.882	820047.854	大葉相思	Acacia mangium	200	4	15	FELL	FELL	FELL	
3801	CT1157	3801	811627.734	820047.406	大葉相思	Acacia mangium	210	4	15	FELL	FELL	FELL	
3801	CT1158	3801	811625.486	820032.298	大葉相思	Acacia mangium	200	4	15	FELL	FELL	FELL	
3801	CT116	3801	811706.347	820149.170	台灣相思	Acacia confusa	220	8	8	FELL	FELL	FELL	
3801	CT1164	3801	811632.061	820041.410	大葉相思	Acacia mangium	560	8	15	FELL	FELL	FELL	
3801	CT1165	3801	811634.854	820043.787	台灣相思	Acacia confusa	100	4	15	FELL	FELL	FELL	
3801	CT1166	3801	811634.853	820045.135	台灣相思	Acacia confusa	260	5	15	FELL	FELL	FELL	
3801	CT1167	3801	811635.727	820044.693	台灣相思	Acacia confusa	200	4	15	FELL	FELL	FELL	
3801	CT1168	3801	811637.726	820042.463	台灣相思	Acacia confusa	220	8	15	FELL	FELL	FELL	
3801	CT1169	3801	811638.538	820042.044	台灣相思	Acacia confusa	190	6	15	FELL	FELL	FELL	
3801	CT117	3801	811707.663	820148.779	苦楝	Melia azedarach	110	5	9	FELL	FELL	FELL	
3801	CT1170	3801	811640.857	820047.005	苦楝	Melia azedarach	260	5	16	FELL	FELL	FELL	
3801	CT1172	3801	811635.452	820050.197	大葉相思	Acacia mangium	170	5	13	FELL	FELL	FELL	
3801	CT1174	3801	811643.340	820044.909	苦楝	Melia azedarach	120	4	10	FELL	FELL	FELL	
3801	CT1175	3801	811647.168	820048.671	大葉相思	Acacia mangium	180	3	16	FELL	FELL	FELL	
3801	CT1176	3801	811646.197	820048.819	大葉相思	Acacia mangium	150	3	15	FELL	FELL	FELL	
3801	CT1177	3801	811647.399	820049.684	大葉相思	Acacia mangium	210	4	16	FELL	FELL	FELL	
3801	CT1178	3801	811646.640	820049.654	大葉相思	Acacia mangium	140	4	15	FELL	FELL	FELL	
3801	CT1179	3801	811645.758	820050.287	大葉相思	Acacia mangium	180	4	15	FELL	FELL	FELL	
3801	CT118	3801	811705.761	820150.826	銀合歡	Leucaena leucocephala	150	6	12	FELL	FELL	FELL	
3801	CT1180	3801	811645.450	820049.221	大葉相思	Acacia mangium	210	4	16	FELL	FELL	FELL	
3801	CT1181	3801	811643.271	820050.480	大葉相思	Acacia mangium	230	6	15	FELL	FELL	FELL	
3801	CT1183	3801	811643.274	820052.950	大葉相思	Acacia mangium	200	4	15	FELL	FELL	FELL	
3801	CT1184	3801	811642.496	820053.529	大葉相思	Acacia mangium	140	1	15	FELL	FELL	FELL	
3801	CT1185	3801	811645.629	820052.199	大葉相思	Acacia mangium	230	5	16	FELL	FELL	FELL	
3801	CT1186	3801	811646.430	820053.883	台灣相思	Acacia confusa	120	4	9	FELL	FELL	FELL	
3801	CT1187	3801	811650.231	820052.131	紅膠木	Lophostemon confertus	110	4	9	FELL	FELL	FELL	
3801	CT1188	3801	811651.140	820053.474	台灣相思	Acacia confusa	170	5	14	FELL	FELL	FELL	
3801	CT1189	3801	811649.912	820055.087	台灣相思	Acacia confusa	110	3	13	FELL	FELL	FELL	
3801	CT119	3801	811702.085	820153.875	銀合歡	Leucaena leucocephala	186	5	11	FELL	FELL	FELL	
3801	CT1190	3801	811650.468	820060.683	台灣相思	Acacia confusa	220	5	15	FELL	FELL	FELL	
3801	CT1191	3801	811652.187	820058.898	台灣相思	Acacia confusa	110	3	14	FELL	FELL	FELL	
3801	CT1192	3801	811654.182	820059.095	台灣相思	Acacia confusa	140	4	14	FELL	FELL	FELL	
3801	CT1193	3801	811655.487	820060.236	台灣相思	Acacia confusa	110	3	13	FELL	FELL	FELL	
3801	CT1195	3801	811658.884	820062.634	台灣相思	Acacia confusa	130	5	14	FELL	FELL	FELL	
3801	CT1196	3801	811658.433	820059.086	台灣相思	Acacia confusa	190	5	13	FELL	FELL	FELL	
3801	CT1197	3801	811663.043	820060.145	台灣相思	Acacia confusa	120	4	11	FELL	FELL	FELL	
3801	CT1198	3801	811660.394	820060.711	台灣相思	Acacia confusa	110	4	14	FELL	FELL	FELL	
3801	CT1199	3801	811662.340	820061.619	台灣相思	Acacia confusa	200	5	12	FELL	FELL	FELL	
3801	CT120	3801	811702.188	820151.943	羊蹄甲屬	Bauhinia spp.	100	6	7	FELL	FELL	FELL	
3801	CT1200	3801	811662.964	820061.084	台灣相思	Acacia confusa	140	4	11	FELL	FELL	FELL	
3801	CT1201	3801	811664.458	820064.519	台灣相思	Acacia confusa	100	3	7	FELL	FELL	FELL	
3801	CT1202	3801	811663.410	820064.703	台灣相思	Acacia confusa	100	4	8	FELL	FELL	FELL	
3801	CT1203	3801	811665.251	820065.394	台灣相思	Acacia confusa	110	4	10	FELL	FELL	FELL	
3801	CT1204	3801	811663.421	820065.990	台灣相思	Acacia confusa	140	5	9	FELL	FELL	FELL	
3801	CT1205	3801	811666.248	820066.615	黃槿	Hibiscus tiliaceus	190	7	13	FELL	FELL	FELL	
3801	CT1206	3801	811665.529	820068.028	台灣相思	Acacia confusa	140	4	14	FELL	FELL	FELL	
3801	CT1207	3801	811662.625	820067.925	台灣相思	Acacia confusa	100	5	11	FELL	FELL	FELL	
3801	CT1208	3801	811662.574	820067.142	台灣相思	Acacia confusa	180	5	11	FELL	FELL	FELL	
3801	CT1209	3801	811661.430	820067.505	台灣相思	Acacia confusa	170	4	13	FELL	FELL	FELL	
3801	CT121	3801	811697.537	820157.064	台灣相思	Acacia confusa	140	6	9	FELL	FELL	FELL	
3801	CT1210	3801	811661.889	820068.614	台灣相思	Acacia confusa	170	4	13	FELL	FELL	FELL	
3801	CT1211	3801	811660.773	820068.864	台灣相思	Acacia confusa	140	5	8	FELL	FELL	FELL	
3801	CT1212	3801	811659.711	820068.287	台灣相思	Acacia confusa	100	5	7	FELL	FELL	FELL	
3801	CT1213	3801	811660.620	820066.902	台灣相思	Acacia confusa	150	6	14	FELL	FELL	FELL	
3801	CT1214	3801	811660.827	820066.009	台灣相思	Acacia confusa	120	4	10	FELL	FELL	FELL	
3801	CT1215	3801	811661.478	820065.705	苦楝	Melia azedarach	350	8	15	FELL	FELL	FELL	
3801	CT1216	3801	811658.891	820066.853	台灣相思	Acacia confusa	110	5	9	FELL	FELL	FELL	
3801	CT1217	3801	811642.036	820069.080	黃槿	Hibiscus tiliaceus	170	7	7	FELL	FELL	FELL	
3801	CT122	3801	811697.277	820156.280	台灣相思	Acacia confusa	122	6	6	FELL	FELL	FELL	
3801	CT1221	3801	811651.082	820064.429	台灣相思	Acacia confusa	160	6	14	FELL	FELL	FELL	
3801	CT1222	3801	811650.983	820063.225	台灣相思	Acacia confusa	110	4	14	FELL	FELL	FELL	
3801	CT1224	3801	811649.110	820055.915	台灣相思	Acacia confusa	100	4	12	FELL	FELL	FELL	
3801	CT1225	3801	811645.138	820057.496	紅膠木	Lophostemon confertus	130	4	11	FELL	FELL	FELL	
3801	CT1226	3801	811646.680	820061.645	台灣相思	Acacia confusa	100	3	10	FELL	FELL	FELL	
3801	CT1227	3801	811646.453	820065.996	台灣相思	Acacia confusa	140	5	10	FELL	FELL	FELL	
3801	CT123	3801	811695.152	820152.291	銀合歡	Leucaena leucocephala	120	8	4	FELL	FELL	FELL	
3801	CT1230	3801	811642.252	820065.051	大葉相思	Acacia mangium	300	5	15	FELL	FELL	FELL	
3801	CT1233	3801	811641.814	820058.809	大葉相思	Acacia mangium	220	4	13	FELL	FELL	FELL	
3801	CT1234	3801	811640.277	820056.745	大葉相思	Acacia mangium	490	5	11	FELL	FELL	FELL	
3801	CT1236	3801	811637.069	820057.613	紅膠木	Lophostemon confertus	150	5	9	FELL	FELL	FELL	
3801	CT1237	3801	811636.263	820057.154	紅膠木	Lophostemon confertus	140	7	8	FELL	FELL	FELL	
3801	CT1239	3801	811633.574	820054.150	台灣相思	Acacia confusa	140	4	12	FELL	FELL	FELL	
3801	CT124	3801	811695.622	820158.091	大葉相思	Acacia mangium	140	4	11	FELL	FELL	FELL	
3801	CT1240	3801	811633.596	820052.218	台灣相思	Acacia confusa	100	4	10	FELL	FELL	FELL	
3801	CT1241	3801	811632.650	820052.715	台灣相思	Acacia confusa	100	4	9	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1242	3801	811631.635	820055.291	大葉相思	Acacia mangium	180	3	15	FELL	FELL	FELL	
3801	CT1244	3801	811630.680	820052.887	大葉相思	Acacia mangium	260	3	16	FELL	FELL	FELL	
3801	CT1245	3801	811628.597	820052.926	台灣相思	Acacia confusa	240	5	15	FELL	FELL	FELL	
3801	CT1247	3801	811624.968	820052.652	苦楝	Melia azedarach	280	9	16	FELL	FELL	FELL	
3801	CT1248	3801	811623.953	820053.506	苦楝	Melia azedarach	220	6	14	FELL	FELL	FELL	
3801	CT1249	3801	811624.959	820054.452	黃槿	Hibiscus tiliaceus	150	5	13	FELL	FELL	FELL	
3801	CT1125	3801	811694.041	820158.993	台灣相思	Acacia confusa	110	5	9	FELL	FELL	FELL	
3801	CT1250	3801	811623.931	820055.134	黃槿	Hibiscus tiliaceus	110	4	12	FELL	FELL	FELL	
3801	CT1251	3801	811628.667	820058.672	台灣相思	Acacia confusa	180	4	15	FELL	FELL	FELL	
3801	CT1252	3801	811627.483	820059.908	台灣相思	Acacia confusa	130	5	13	FELL	FELL	FELL	
3801	CT1253	SLPS	811627.492	820062.194	羊蹄甲屬	Bauhinia spp.	110	5	10	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3801	CT1254	3801	811625.276	820062.024	台灣相思	Acacia confusa	130	4	14	FELL	FELL	FELL	
3801	CT1255	3801	811625.053	820059.890	台灣相思	Acacia confusa	100	4	10	FELL	FELL	FELL	
3801	CT1256	3801	811626.243	820059.254	台灣相思	Acacia confusa	100	2	14	FELL	FELL	FELL	
3801	CT1257	3801	811626.096	820057.985	台灣相思	Acacia confusa	140	4	15	FELL	FELL	FELL	
3801	CT1258	3801	811625.230	820058.734	台灣相思	Acacia confusa	190	6	15	FELL	FELL	FELL	
3801	CT1259	3801	811623.876	820059.493	台灣相思	Acacia confusa	160	5	15	FELL	FELL	FELL	
3801	CT1126	3801	811694.133	820160.858	黃花夾竹桃	Thevetia peruviana	100	5	6	FELL	FELL	FELL	
3801	CT1260	3801	811623.284	820059.999	台灣相思	Acacia confusa	100	4	11	FELL	FELL	FELL	
3801	CT1261	3801	811621.412	820059.069	大葉相思	Acacia mangium	230	4	15	FELL	FELL	FELL	
3801	CT1262	3801	811622.963	820057.720	台灣相思	Acacia confusa	150	3	15	FELL	FELL	FELL	
3801	CT1263	3801	811622.836	820055.500	黃槿	Hibiscus tiliaceus	130	4	12	FELL	FELL	FELL	
3801	CT1264	3801	811621.279	820056.564	台灣相思	Acacia confusa	100	5	8	FELL	FELL	FELL	
3801	CT1265	3801	811619.348	820054.325	紅膠木	Lophostemon confertus	100	5	8	FELL	FELL	FELL	
3801	CT1266	3801	811620.374	820057.219	大葉相思	Acacia mangium	120	1	6	FELL	FELL	FELL	
3801	CT1267	3801	811619.655	820057.960	大葉相思	Acacia mangium	350	5	16	FELL	FELL	FELL	
3801	CT1268	3801	811617.395	820058.807	苦楝	Melia azedarach	150	6	11	FELL	FELL	FELL	
3801	CT1269	3801	811619.470	820058.930	大葉相思	Acacia mangium	130	1	11	FELL	FELL	FELL	
3801	CT127	3801	811692.824	820160.944	大葉相思	Acacia mangium	220	6	12	FELL	FELL	FELL	
3801	CT1270	3801	811619.393	820059.762	大葉相思	Acacia mangium	160	2	14	FELL	FELL	FELL	
3801	CT1271	3801	811624.011	820062.722	台灣相思	Acacia confusa	180	3	15	FELL	FELL	FELL	
3801	CT1272	3801	811622.316	820064.100	台灣相思	Acacia confusa	190	5	12	FELL	FELL	FELL	
3801	CT1273	3801	811621.141	820063.192	台灣相思	Acacia confusa	170	3	11	FELL	FELL	FELL	
3801	CT1274	3801	811618.461	820062.540	苦楝	Melia azedarach	280	6	15	FELL	FELL	FELL	
3801	CT1275	3801	811618.213	820063.536	台灣相思	Acacia confusa	180	4	10	FELL	FELL	FELL	
3801	CT1276	3801	811620.568	820065.793	台灣相思	Acacia confusa	260	6	11	FELL	FELL	FELL	
3801	CT1277	3801	811615.659	820057.847	台灣相思	Acacia confusa	190	8	8	FELL	FELL	FELL	
3801	CT1278	3801	811614.812	820058.290	尾葉桉	Eucalyptus urophylla	450	8	20	FELL	FELL	FELL	
3801	CT128	3801	811690.112	820162.537	大葉相思	Acacia mangium	330	7	15	FELL	FELL	FELL	
3801	CT1280	3801	811613.313	820058.735	紅膠木	Lophostemon confertus	110	5	9	FELL	FELL	FELL	
3801	CT1281	3801	811610.873	820058.940	大葉相思	Acacia mangium	360	7	16	FELL	FELL	FELL	
3801	CT1282	3801	811610.668	820060.409	大葉相思	Acacia mangium	120	5	7	FELL	FELL	FELL	
3801	CT1283	3801	811610.597	820062.377	大葉相思	Acacia mangium	230	4	16	FELL	FELL	FELL	
3801	CT1284	3801	811607.665	820059.682	大葉相思	Acacia mangium	290	6	12	FELL	FELL	FELL	
3801	CT1285	3801	811607.536	820060.925	大葉相思	Acacia mangium	220	4	15	FELL	FELL	FELL	
3801	CT1287	3801	811608.440	820066.620	台灣相思	Acacia confusa	240	6	12	FELL	FELL	FELL	
3801	CT1288	3801	811606.768	820069.493	大葉相思	Acacia mangium	250	5	12	FELL	FELL	FELL	
3801	CT1289	3801	811605.304	820069.953	大葉相思	Acacia mangium	380	8	12	FELL	FELL	FELL	
3801	CT129	3801	811690.358	820160.586	大葉相思	Acacia mangium	130	7	10	FELL	FELL	FELL	
3801	CT1290	3801	811603.451	820068.775	大葉相思	Acacia mangium	320	8	15	FELL	FELL	FELL	
3801	CT1291	3801	811605.452	820067.383	台灣相思	Acacia confusa	210	9	10	FELL	FELL	FELL	
3801	CT1292	3801	811606.745	820067.803	台灣相思	Acacia confusa	250	5	15	FELL	FELL	FELL	
3801	CT1293	3801	811606.717	820066.758	台灣相思	Acacia confusa	140	4	12	FELL	FELL	FELL	
3801	CT1294	3801	811606.785	820066.146	台灣相思	Acacia confusa	100	4	7	FELL	FELL	FELL	
3801	CT1295	3801	811606.498	820064.918	台灣相思	Acacia confusa	120	5	8	FELL	FELL	FELL	
3801	CT1296	3801	811605.550	820065.321	台灣相思	Acacia confusa	100	6	8	FELL	FELL	FELL	
3801	CT1297	3801	811604.589	820063.802	台灣相思	Acacia confusa	380	8	11	FELL	FELL	FELL	
3801	CT1298	3801	811603.751	820063.459	台灣相思	Acacia confusa	140	5	4	FELL	FELL	FELL	
3801	CT130	3801	811688.375	820158.488	台灣相思	Acacia confusa	120	4	11	FELL	FELL	FELL	
3801	CT1300	3801	811618.362	820072.427	台灣相思	Acacia confusa	120	3	8	FELL	FELL	FELL	
3801	CT1302	3801	811622.585	820065.226	台灣相思	Acacia confusa	150	5	11	FELL	FELL	FELL	
3801	CT1303	3801	811626.904	820071.159	大葉相思	Acacia mangium	200	4	14	FELL	FELL	FELL	
3801	CT1306	3801	811629.785	820070.348	大葉相思	Acacia mangium	160	3	14	FELL	FELL	FELL	
3801	CT1307	3801	811628.994	820073.017	大葉相思	Acacia mangium	230	4	15	FELL	FELL	FELL	
3801	CT1308	3801	811635.324	820073.108	大葉相思	Acacia mangium	120	4	14	FELL	FELL	FELL	
3801	CT1309	3801	811635.673	820071.721	大葉相思	Acacia mangium	180	5	14	FELL	FELL	FELL	
3801	CT131	3801	811693.742	820155.840	大葉相思	Acacia mangium	220	4	8	FELL	FELL	FELL	
3801	CT1311	3801	811637.911	820070.255	大葉相思	Acacia mangium	300	5	15	FELL	FELL	FELL	
3801	CT1313	3801	811639.084	820071.703	大葉相思	Acacia mangium	300	6	15	FELL	FELL	FELL	
3801	CT1314	3801	811640.729	820070.597	大葉相思	Acacia mangium	150	2	8	FELL	FELL	FELL	
3801	CT1315	3801	811639.819	820072.291	大葉相思	Acacia mangium	160	4	11	FELL	FELL	FELL	
3801	CT1316	3801	811637.298	820075.442	台灣相思	Acacia confusa	170	4	14	FELL	FELL	FELL	
3801	CT1317	3801	811636.247	820076.238	台灣相思	Acacia confusa	150	4	15	FELL	FELL	FELL	
3801	CT1319	3801	811634.887	820077.749	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT132	3801	811693.236	820155.279	大葉相思	Acacia mangium	140	3	11	FELL	FELL	FELL	
3801	CT1320	3801	811632.856	820076.156	台灣相思	Acacia confusa	170	6	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1321	3801	811631.814	820077.456	台灣相思	Acacia confusa	130	2	10	FELL	FELL	FELL	
3801	CT1322	3801	811630.009	820078.671	苦楝	Melia azedarach	270	5	14	FELL	FELL	FELL	
3801	CT1323	3801	811622.014	820078.397	大葉相思	Acacia mangium	140	7	6	FELL	FELL	FELL	
3801	CT1324	3801	811621.603	820078.664	大葉相思	Acacia mangium	260	6	13	FELL	FELL	FELL	
3801	CT1325	3801	811619.443	820079.972	大葉相思	Acacia mangium	140	6	10	FELL	FELL	FELL	
3801	CT1326	3801	811620.325	820080.663	大葉相思	Acacia mangium	350	7	12	FELL	FELL	FELL	
3801	CT1327	3801	811612.824	820086.555	旅人蕉	Ravenala madagascariensis	160	2	5	FELL	FELL	FELL	
3801	CT1328	3801	811576.335	820054.894	台灣相思	Acacia confusa	440	12	9	FELL	FELL	FELL	
3801	CT1329	3801	811615.419	820052.415	紅膠木	Lophostemon confertus	100	3	5	FELL	FELL	FELL	
3801	CT133	3801	811691.916	820152.671	大葉相思	Acacia mangium	290	6	12	FELL	FELL	FELL	
3801	CT1334	3801	811643.088	820040.639	大葉相思	Acacia mangium	300	5	14	FELL	FELL	FELL	
3801	CT1335	3801	811643.238	820042.562	黃槿	Hibiscus tiliaceus	110	4	6	FELL	FELL	FELL	
3801	CT1336	3801	811644.853	820044.200	大葉相思	Acacia mangium	150	2	10	FELL	FELL	FELL	
3801	CT1337	3801	811645.467	820044.164	大葉相思	Acacia mangium	250	6	13	FELL	FELL	FELL	
3801	CT1338	3801	811647.339	820045.445	大葉相思	Acacia mangium	310	5	14	FELL	FELL	FELL	
3801	CT1339	3801	811647.985	820044.867	大葉相思	Acacia mangium	160	5	8	FELL	FELL	FELL	
3801	CT134	3801	811691.325	820152.406	苦楝	Melia azedarach	280	7	12	FELL	FELL	FELL	
3801	CT1340	3801	811647.847	820046.273	黃槿	Hibiscus tiliaceus	100	3	7	FELL	FELL	FELL	
3801	CT1342	3801	811652.415	820044.718	死樹	Dead tree	230	4	7	FELL	FELL	FELL	
3801	CT1343	3801	811650.168	820049.929	大葉相思	Acacia mangium	280	4	14	FELL	FELL	FELL	
3801	CT1344	3801	811651.101	820051.318	大葉相思	Acacia mangium	230	3	12	FELL	FELL	FELL	
3801	CT1345	3801	811651.687	820052.090	大葉相思	Acacia mangium	250	5	11	FELL	FELL	FELL	
3801	CT1346	3801	811652.422	820052.719	大葉相思	Acacia mangium	100	4	6	FELL	FELL	FELL	
3801	CT1347	3801	811660.138	820057.935	台灣相思	Acacia confusa	130	5	8	FELL	FELL	FELL	
3801	CT1348	3801	811659.995	820058.726	台灣相思	Acacia confusa	200	4	10	FELL	FELL	FELL	
3801	CT135	3801	811690.529	820151.936	苦楝	Melia azedarach	140	6	10	FELL	FELL	FELL	
3801	CT136	3801	811689.178	820148.711	台灣相思	Acacia confusa	110	5	7	FELL	FELL	FELL	
3801	CT137	3801	811688.138	820148.992	台灣相思	Acacia confusa	120	4	7	FELL	FELL	FELL	
3801	CT1373	N/A	811478.350	820107.230	苦楝	Melia azedarach	220	5	7	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1375	N/A	811478.960	820112.150	台灣相思	Acacia confusa	130	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1376	N/A	811479.940	820111.960	台灣相思	Acacia confusa	110	5	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1378	N/A	811484.080	820113.450	台灣相思	Acacia confusa	180	5	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1379	N/A	811484.940	820114.390	黃花夾竹桃	Thevetia peruviana	100	4	4	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT138	3801	811686.644	820153.384	台灣相思	Acacia confusa	187	5	11	FELL	FELL	FELL	
3801	CT1380	3801	811483.351	820116.098	苦楝	Melia azedarach	150	3	7	FELL	FELL	FELL	
3801	CT1381	3801	811483.244	820117.593	苦楝	Melia azedarach	220	4	7	FELL	FELL	FELL	
3801	CT1382	3801	811485.435	820117.488	黃槿	Hibiscus tiliaceus	130	4	6	FELL	FELL	FELL	
3801	CT1387	N/A	811489.400	820123.200	大葉相思	Acacia mangium	160	4	9	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1388	N/A	811489.950	820123.660	羊蹄甲屬	Bauhinia spp.	100	4	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1389	N/A	811489.802	820124.525	大葉相思	Acacia mangium	230	4	7	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT139	3801	811684.867	820154.505	台灣相思	Acacia confusa	142	6	11	FELL	FELL	FELL	
3801	CT1390	N/A	811493.120	820127.530	台灣相思	Acacia confusa	160	7	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1391	N/A	811493.560	820127.990	台灣相思	Acacia confusa	130	6	7	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1392	N/A	811492.950	820129.490	台灣相思	Acacia confusa	120	6	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1393	N/A	811495.560	820128.240	台灣相思	Acacia confusa	100	5	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1394	N/A	811494.630	820129.660	台灣相思	Acacia confusa	150	3	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1395	N/A	811494.440	820130.760	黃花夾竹桃	Thevetia peruviana	100	4	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1396	N/A	811495.470	820130.990	黃花夾竹桃	Thevetia peruviana	110	5	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1397	N/A	811499.890	820130.570	銀合歡	Leucaena leucocephala	190	6	9	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1398	3801	811504.913	820134.222	黃槿	Hibiscus tiliaceus	110	4	6	FELL	FELL	FELL	
3801	CT1399	N/A	811504.710	820133.380	台灣相思	Acacia confusa	100	4	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT140	3801	811682.454	820154.147	台灣相思	Acacia confusa	220	7	10	FELL	FELL	FELL	
3801	CT1401	N/A	811505.556	820136.879	黃槿	Hibiscus tiliaceus	100	4	6	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1403	N/A	811509.950	820138.500	苦楝	Melia azedarach	130	5	7	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1404	N/A	811510.430	820138.390	苦楝	Melia azedarach	110	4	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1406	3801	811515.030	820144.490	台灣相思	Acacia confusa	100	3	5	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1408	3801	811523.766	820156.346	台灣相思	Acacia confusa	110	4	7	FELL	FELL	FELL	
3801	CT1409	3801	811524.439	820157.794	台灣相思	Acacia confusa	110	4	6	FELL	FELL	FELL	
3801	CT141	3801	811685.461	820158.845	台灣相思	Acacia confusa	214	7	12	FELL	FELL	FELL	
3801	CT1411	3801	811523.190	820161.190	黃花夾竹桃	Thevetia peruviana	100	4	6	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1413	3801	811527.230	820165.090	羊蹄甲屬	Bauhinia spp.	130	6	5	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1414	3801	811525.930	820164.220	羊蹄甲屬	Bauhinia spp.	160	6	6	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1415	3801	811524.080	820163.520	羊蹄甲屬	Bauhinia spp.	130	5	8	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1416	3801	811522.180	820161.470	羊蹄甲屬	Bauhinia spp.	110	6	6	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1417	3801	811521.180	820161.130	台灣相思	Acacia confusa	160	5	11	RETAIN	REMOVED	REMOVED	Confirmed removed due to safety concern of Airport Express Line operation in 2021.
3801	CT1418	3801	811517.310	820159.920	黃槿	Hibiscus tiliaceus	230	8	10	RETAIN	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT142	3801	811681.989	820161.006	銀合歡	Leucaena leucocephala	100	3	13	FELL	FELL	FELL	
3801	CT1426	3802	811488.407	820155.898	大葉相思	Acacia mangium	120	5	5	RETAIN	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1427	3802	811487.122	820155.523	大葉相思	Acacia mangium	410	8	15	RETAIN	FELL	FELL	
3801	CT1428	3802	811486.052	820154.674	大葉相思	Acacia mangium	390	7	16	RETAIN	FELL	FELL	
3801	CT1429	3802	811485.208	820154.697	潺槁樹	Litsea glutinosa	149	6	9	RETAIN	FELL	FELL	
3801	CT143	3801	811679.461	820160.363	台灣相思	Acacia confusa	186	4	12	FELL	FELL	FELL	
3801	CT1430	3801	811482.581	820152.646	黃槿	Hibiscus tiliaceus	180	8	14	FELL	FELL	FELL	
3801	CT1431	3801	811484.712	820149.682	紅膠木	Lophostemon confertus	110	6	6	FELL	FELL	FELL	
3801	CT1432	3802	811486.363	820148.963	紅膠木	Lophostemon confertus	110	4	7	RETAIN	FELL	FELL	
3801	CT1433	3802	811483.288	820147.865	大葉相思	Acacia mangium	280	5	13	RETAIN	FELL	FELL	
3801	CT1434	3801	811484.933	820146.409	黃槿	Hibiscus tiliaceus	200	4	6	FELL	FELL	FELL	
3801	CT1435	3801	811482.598	820145.589	大葉相思	Acacia mangium	180	3	6	FELL	FELL	FELL	
3801	CT1436	3801	811478.942	820150.082	苦楝	Melia azedarach	100	6	8	FELL	FELL	FELL	
3801	CT1437	3801	811476.562	820151.440	紅膠木	Lophostemon confertus	180	4	15	FELL	FELL	FELL	
3801	CT1438	3801	811475.167	820151.343	紅膠木	Lophostemon confertus	149	5	14	FELL	FELL	FELL	
3801	CT1439	3801	811476.251	820146.221	台灣相思	Acacia confusa	110	4	13	FELL	FELL	FELL	
3801	CT144	3801	811678.506	820160.891	台灣相思	Acacia confusa	120	4	12	FELL	FELL	FELL	
3801	CT1440	3801	811475.744	820145.599	台灣相思	Acacia confusa	240	6	15	FELL	FELL	FELL	
3801	CT1442	3801	811468.820	820131.727	黃槿	Hibiscus tiliaceus	190	8	10	FELL	FELL	FELL	
3801	CT1443	N/A	811469.149	820123.608	黃槿	Hibiscus tiliaceus	160	6	9	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1448	N/A	811464.061	820117.944	台灣相思	Acacia confusa	110	4	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1449	N/A	811464.605	820117.022	台灣相思	Acacia confusa	110	3	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT145	3801	811677.559	820161.263	台灣相思	Acacia confusa	120	7	11	FELL	FELL	FELL	
3801	CT1450	N/A	811463.188	820115.153	潺槁樹	Litsea glutinosa	100	5	7	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1451	N/A	811462.516	820116.395	台灣相思	Acacia confusa	180	6	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1452	3801	811460.820	820118.492	大葉相思	Acacia mangium	250	5	13	FELL	FELL	FELL	
3801	CT1453	3801	811457.301	820119.470	羊蹄甲屬	Bauhinia spp.	110	6	7	FELL	FELL	FELL	
3801	CT1454	3801	811456.815	820122.820	細葉榕	Ficus microcarpa	140	4	5	FELL	FELL	FELL	
3801	CT1455	3801	811449.865	820117.011	大葉相思	Acacia mangium	180	5	8	FELL	FELL	FELL	
3801	CT1456	3801	811453.436	820115.681	黃槿	Hibiscus tiliaceus	100	5	8	FELL	FELL	FELL	
3801	CT1457	3801	811453.633	820114.931	黃槿	Hibiscus tiliaceus	130	6	10	FELL	FELL	FELL	
3801	CT1458	3801	811454.686	820114.537	黃槿	Hibiscus tiliaceus	160	5	10	FELL	FELL	FELL	
3801	CT1459	3801	811456.069	820114.382	黃槿	Hibiscus tiliaceus	130	4	10	FELL	FELL	FELL	
3801	CT146	3801	811677.850	820155.510	苦楝	Melia azedarach	360	14	12	FELL	FELL	FELL	
3801	CT1460	3801	811454.371	820112.693	大葉相思	Acacia mangium	190	6	10	FELL	FELL	FELL	
3801	CT1461	3801	811455.518	820112.302	大葉相思	Acacia mangium	150	5	11	FELL	FELL	FELL	
3801	CT1465	N/A	811459.544	820110.471	台灣相思	Acacia confusa	110	7	7	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1469	N/A	811456.928	820104.333	黃槿	Hibiscus tiliaceus	190	8	11	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT147	3801	811676.956	820157.021	銀合歡	Leucaena leucocephala	120	7	11	FELL	FELL	FELL	
3801	CT1470	N/A	811454.386	820104.735	大葉相思	Acacia mangium	350	7	15	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1471	3801	811450.719	820111.181	羊蹄甲屬	Bauhinia spp.	210	7	9	FELL	FELL	FELL	
3801	CT1472	3801	811440.179	820139.344	台灣相思	Acacia confusa	340	7	14	FELL	FELL	FELL	
3801	CT1473	3801	811441.608	820140.438	台灣相思	Acacia confusa	269	7	7	FELL	FELL	FELL	
3801	CT1474	3801	811442.852	820140.406	大葉相思	Acacia mangium	260	5	10	FELL	FELL	FELL	
3801	CT1475	3801	811443.547	820140.181	大葉相思	Acacia mangium	210	6	13	FELL	FELL	FELL	
3801	CT1476	3801	811444.064	820139.125	大葉相思	Acacia mangium	110	5	6	FELL	FELL	FELL	
3801	CT1477	3801	811446.706	820140.094	大葉相思	Acacia mangium	350	8	15	FELL	FELL	FELL	
3801	CT1478	3801	811446.402	820140.830	大葉相思	Acacia mangium	260	8	14	FELL	FELL	FELL	
3801	CT1479	3801	811448.072	820142.206	紅膠木	Lophostemon confertus	150	5	10	FELL	FELL	FELL	
3801	CT148	3801	811673.636	820157.351	台灣相思	Acacia confusa	110	6	10	FELL	FELL	FELL	
3801	CT1480	3801	811449.306	820142.725	紅膠木	Lophostemon confertus	150	5	9	FELL	FELL	FELL	
3801	CT1481	3801	811450.085	820140.740	紅膠木	Lophostemon confertus	110	4	10	FELL	FELL	FELL	
3801	CT1482	3801	811450.558	820141.599	紅膠木	Lophostemon confertus	220	3	15	FELL	FELL	FELL	
3801	CT1483	3801	811450.388	820132.627	黃槿	Hibiscus tiliaceus	254	8	10	FELL	FELL	FELL	
3801	CT1484	3801	811451.668	820134.187	黃槿	Hibiscus tiliaceus	230	8	10	FELL	FELL	FELL	
3801	CT1485	3801	811457.459	820129.115	細葉榕	Ficus microcarpa	140	5	7	FELL	FELL	FELL	
3801	CT1486	3801	811463.072	820135.838	黃槿	Hibiscus tiliaceus	100	5	8	FELL	FELL	FELL	
3801	CT1487	3801	811461.865	820136.852	黃槿	Hibiscus tiliaceus	170	8	11	FELL	FELL	FELL	
3801	CT1488	3801	811461.273	820137.744	黃槿	Hibiscus tiliaceus	150	6	10	FELL	FELL	FELL	
3801	CT1489	3801	811459.659	820137.312	台灣相思	Acacia confusa	100	5	10	FELL	FELL	FELL	
3801	CT149	3801	811673.213	820158.776	台灣相思	Acacia confusa	158	7	10	FELL	FELL	FELL	
3801	CT1490	3801	811453.169	820143.395	黃槿	Hibiscus tiliaceus	100	12	8	FELL	FELL	FELL	
3801	CT1491	3801	811454.113	820142.348	黃槿	Hibiscus tiliaceus	200	7	13	FELL	FELL	FELL	
3801	CT1492	3801	811454.555	820143.391	黃槿	Hibiscus tiliaceus	140	7	12	FELL	FELL	FELL	
3801	CT1493	3801	811455.170	820144.072	黃槿	Hibiscus tiliaceus	130	6	8	FELL	FELL	FELL	
3801	CT1494	3801	811455.622	820143.023	黃槿	Hibiscus tiliaceus	140	5	12	FELL	FELL	FELL	
3801	CT1495	3801	811456.677	820144.407	黃槿	Hibiscus tiliaceus	320	12	14	FELL	FELL	FELL	
3801	CT1496	3801	811458.068	820144.427	黃槿	Hibiscus tiliaceus	250	12	14	FELL	FELL	FELL	
3801	CT1497	3801	811457.804	820142.600	黃槿	Hibiscus tiliaceus	170	8	10	FELL	FELL	FELL	
3801	CT1498	3801	811459.400	820142.432	黃槿	Hibiscus tiliaceus	170	6	12	FELL	FELL	FELL	
3801	CT1499	3801	811458.729	820145.511	大葉相思	Acacia mangium	200	6	15	FELL	FELL	FELL	
3801	CT150	3801	811672.400	820158.169	台灣相思	Acacia confusa	100	5	11	FELL	FELL	FELL	
3801	CT1500	3801	811460.064	820145.233	大葉相思	Acacia mangium	300	6	13	FELL	FELL	FELL	
3801	CT1501	3801	811460.764	820146.292	大葉相思	Acacia mangium	170	5	11	FELL	FELL	FELL	
3801	CT1502	3801	811464.165	820143.652	羊蹄甲屬	Bauhinia spp.	110	8	10	FELL	FELL	FELL	
3801	CT1503	3801	811464.748	820144.361	羊蹄甲屬	Bauhinia spp.	180	8	15	FELL	FELL	FELL	
3801	CT1504	3801	811464.766	820147.468	羊蹄甲屬	Bauhinia spp.	100	5	6	FELL	FELL	FELL	
3801	CT1505	3801	811466.932	820146.691	台灣相思	Acacia confusa	150	3	15	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1506	3801	811467.327	820147.260	台灣相思	Acacia confusa	200	10	15	FELL	FELL	FELL	
3801	CT1507	3801	811467.737	820146.199	台灣相思	Acacia confusa	180	6	15	FELL	FELL	FELL	
3801	CT1508	3801	811469.768	820143.836	黃槿	Hibiscus tiliaceus	170	7	10	FELL	FELL	FELL	
3801	CT1509	3801	811470.662	820146.178	黃槿	Hibiscus tiliaceus	120	7	7	FELL	FELL	FELL	
3801	CT151	3801	811669.638	820159.704	台灣相思	Acacia confusa	184	7	10	FELL	FELL	FELL	
3801	CT1510	3801	811468.988	820147.294	黃槿	Hibiscus tiliaceus	220	9	14	FELL	FELL	FELL	
3801	CT1511	3801	811470.221	820147.208	黃槿	Hibiscus tiliaceus	230	8	13	FELL	FELL	FELL	
3801	CT1512	3801	811470.411	820148.880	黃槿	Hibiscus tiliaceus	310	12	15	FELL	FELL	FELL	
3801	CT1513	3801	811469.145	820149.581	黃槿	Hibiscus tiliaceus	140	7	12	FELL	FELL	FELL	
3801	CT1514	3801	811468.771	820148.627	黃槿	Hibiscus tiliaceus	230	8	15	FELL	FELL	FELL	
3801	CT1515	3802	811445.192	820185.063	羊蹄甲屬	Bauhinia spp.	160	4	7	RETAIN	FELL	FELL	
3801	CT1516	3802	811447.273	820185.038	羊蹄甲屬	Bauhinia spp.	120	4	6	RETAIN	FELL	FELL	
3801	CT1517	3802	811449.007	820185.903	苦楝	Melia azedarach	140	5	5	RETAIN	FELL	FELL	
3801	CT1518	3802	811502.864	820197.557	大葉相思	Acacia mangium	310	7	10	RETAIN	FELL	FELL	
3801	CT1519	3802	811503.420	820197.576	大葉相思	Acacia mangium	150	5	8	RETAIN	FELL	FELL	
3801	CT152	3801	811668.613	820159.904	台灣相思	Acacia confusa	140	6	10	FELL	FELL	FELL	
3801	CT1520	3802	811503.390	820198.788	紅膠木	Lophostemon confertus	140	5	6	RETAIN	FELL	FELL	
3801	CT1521	3802	811504.484	820198.881	紅膠木	Lophostemon confertus	110	5	5	RETAIN	FELL	FELL	
3801	CT1522	3802	811507.675	820200.094	大葉相思	Acacia mangium	300	8	11	RETAIN	FELL	FELL	
3801	CT1523	3802	811509.224	820197.715	台灣相思	Acacia confusa	480	10	10	RETAIN	FELL	FELL	
3801	CT1524	3802	811512.232	820199.176	潺槁樹	Litsea glutinosa	340	8	7	RETAIN	FELL	FELL	
3801	CT1525	3801	811524.855	820196.62	黃槿	Hibiscus tiliaceus	315	9	9	FELL	FELL	FELL	
3801	CT1526	3801	811528.464	820197.931	潺槁樹	Litsea glutinosa	130	2	8	FELL	FELL	FELL	
3801	CT1527	3801	811530.157	820202.241	台灣相思	Acacia confusa	190	8	9	FELL	FELL	FELL	
3801	CT1528	3801	811531.456	820201.819	台灣相思	Acacia confusa	170	8	10	FELL	FELL	FELL	
3801	CT1529	3801	811532.798	820201.518	台灣相思	Acacia confusa	230	6	11	FELL	FELL	FELL	
3801	CT153	3801	811667.746	820163.081	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT1530	3801	811533.631	820203.323	台灣相思	Acacia confusa	160	6	11	FELL	FELL	FELL	
3801	CT1531	3801	811533.060	820203.957	台灣相思	Acacia confusa	120	7	12	FELL	FELL	FELL	
3801	CT1532	3801	811528.736	820205.350	黃槿	Hibiscus tiliaceus	260	14	12	FELL	FELL	FELL	
3801	CT1533	3801	811527.794	820205.283	黃槿	Hibiscus tiliaceus	256	7	11	FELL	FELL	FELL	
3801	CT1536	3801	811529.440	820207.638	黃槿	Hibiscus tiliaceus	180	6	10	FELL	FELL	FELL	
3801	CT1537	3801	811530.052	820215.424	黃槿	Hibiscus tiliaceus	343	8	10	FELL	FELL	FELL	
3801	CT1538	3801	811531.053	820214.455	黃槿	Hibiscus tiliaceus	140	5	10	FELL	FELL	FELL	
3801	CT1539	3801	811531.553	820215.492	黃槿	Hibiscus tiliaceus	312	9	10	FELL	FELL	FELL	
3801	CT154	3801	811666.662	820162.647	台灣相思	Acacia confusa	140	7	12	FELL	FELL	FELL	
3801	CT1540	3801	811533.317	820209.086	台灣相思	Acacia confusa	110	5	10	FELL	FELL	FELL	
3801	CT1541	3801	811534.340	820209.244	台灣相思	Acacia confusa	130	5	11	FELL	FELL	FELL	
3801	CT1542	3801	811535.438	820209.635	台灣相思	Acacia confusa	160	5	11	FELL	FELL	FELL	
3801	CT1543	3801	811534.437	820208.264	台灣相思	Acacia confusa	350	11	14	FELL	FELL	FELL	
3801	CT1544	3801	811541.329	820209.083	黃槿	Hibiscus tiliaceus	150	7	11	FELL	FELL	FELL	
3801	CT1545	3801	811542.621	820209.510	黃槿	Hibiscus tiliaceus	100	7	7	FELL	FELL	FELL	
3801	CT1546	3801	811542.151	820211.165	黃槿	Hibiscus tiliaceus	150	7	10	FELL	FELL	FELL	
3801	CT1547	3801	811544.149	820211.673	台灣相思	Acacia confusa	190	7	13	FELL	FELL	FELL	
3801	CT1548	3801	811544.413	820210.407	台灣相思	Acacia confusa	270	8	14	FELL	FELL	FELL	
3801	CT1549	3801	811546.865	820211.707	大葉相思	Acacia mangium	170	5	11	FELL	FELL	FELL	
3801	CT155	3801	811666.611	820163.807	台灣相思	Acacia confusa	100	6	6	FELL	FELL	FELL	
3801	CT1550	3801	811546.747	820212.665	大葉相思	Acacia mangium	160	5	10	FELL	FELL	FELL	
3801	CT1551	3801	811547.796	820215.863	羊蹄甲屬	Bauhinia spp.	100	5	5	FELL	FELL	FELL	
3801	CT1552	3801	811545.487	820215.402	羊蹄甲屬	Bauhinia spp.	120	5	8	FELL	FELL	FELL	
3801	CT1553	3801	811538.095	820217.971	大葉相思	Acacia mangium	160	4	9	FELL	FELL	FELL	
3801	CT1554	3801	811539.014	820218.602	大葉相思	Acacia mangium	100	4	7	FELL	FELL	FELL	
3801	CT1555	3801	811539.321	820219.454	大葉相思	Acacia mangium	220	5	12	FELL	FELL	FELL	
3801	CT1556	3801	811539.868	820218.663	大葉相思	Acacia mangium	290	6	13	FELL	FELL	FELL	
3801	CT1557	3801	811540.921	820221.041	黃槿	Hibiscus tiliaceus	250	6	8	FELL	FELL	FELL	
3801	CT1558	3801	811541.612	820218.749	大葉相思	Acacia mangium	280	6	11	FELL	FELL	FELL	
3801	CT1559	3801	811542.978	820221.187	黃槿	Hibiscus tiliaceus	190	6	10	FELL	FELL	FELL	
3801	CT156	3801	811665.051	820163.492	台灣相思	Acacia confusa	110	5	10	FELL	FELL	FELL	
3801	CT1560	3801	811542.915	820222.447	黃槿	Hibiscus tiliaceus	180	5	10	FELL	FELL	FELL	
3801	CT1561	3801	811544.355	820222.750	黃槿	Hibiscus tiliaceus	350	10	8	FELL	FELL	FELL	
3801	CT1562	3801	811543.772	820221.872	黃槿	Hibiscus tiliaceus	100	5	9	FELL	FELL	FELL	
3801	CT1563	3801	811547.428	820222.653	紅花夾竹桃	Nerium indicum	160	8	6	FELL	FELL	FELL	
3801	CT1564	3801	811551.029	820225.987	大葉相思	Acacia mangium	180	4	9	FELL	FELL	FELL	
3801	CT1565	3801	811552.028	820223.701	大葉相思	Acacia mangium	210	7	10	FELL	FELL	FELL	
3801	CT1566	3801	811552.941	820224.343	大葉相思	Acacia mangium	330	8	11	FELL	FELL	FELL	
3801	CT1567	3801	811553.772	820224.388	大葉相思	Acacia mangium	140	4	8	FELL	FELL	FELL	
3801	CT1568	3801	811554.754	820216.516	紅膠木	Lophostemon confertus	160	3	9	FELL	FELL	FELL	
3801	CT1569	3801	811554.812	820217.597	紅膠木	Lophostemon confertus	200	4	9	FELL	FELL	FELL	
3801	CT157	3801	811664.319	820163.098	台灣相思	Acacia confusa	140	5	9	FELL	FELL	FELL	
3801	CT1570	3801	811580.721	820232.601	濕地松	Pinus elliottii	140	4	7	FELL	FELL	FELL	
3801	CT1571	3801	811582.050	820232.978	濕地松	Pinus elliottii	120	3	7	FELL	FELL	FELL	
3801	CT1572	3801	811584.740	820234.111	濕地松	Pinus elliottii	100	2	6	FELL	FELL	FELL	
3801	CT158	3801	811664.962	820164.489	台灣相思	Acacia confusa	140	7	10	FELL	FELL	FELL	
3801	CT159	3801	811664.143	820165.097	台灣相思	Acacia confusa	158	7	9	FELL	FELL	FELL	
3801	CT161	3801	811666.039	820169.281	銀合歡	Leucaena leucocephala	110	6	14	FELL	FELL	FELL	
3801	CT162	3801	811668.833	820166.265	台灣相思	Acacia confusa	164	7	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT163	3801	811669.172	820164.397	台灣相思	Acacia confusa	100	6	8	FELL	FELL	FELL	
3801	CT164	3801	811669.899	820164.371	台灣相思	Acacia confusa	150	6	11	FELL	FELL	FELL	
3801	CT165	3801	811677.860	820166.248	台灣相思	Acacia confusa	120	5	12	FELL	FELL	FELL	
3801	CT166	3801	811677.983	820168.284	台灣相思	Acacia confusa	140	5	15	FELL	FELL	FELL	
3801	CT167	3801	811677.161	820168.643	台灣相思	Acacia confusa	100	6	10	FELL	FELL	FELL	
3801	CT168	3801	811675.424	820169.247	台灣相思	Acacia confusa	140	7	13	FELL	FELL	FELL	
3801	CT169	3801	811686.062	820165.938	苦楝	Melia azedarach	210	7	14	FELL	FELL	FELL	
3801	CT170	3801	811683.474	820167.147	大葉相思	Acacia mangium	210	7	15	FELL	FELL	FELL	
3801	CT171	3801	811681.322	820169.796	大葉相思	Acacia mangium	190	6	12	FELL	FELL	FELL	
3801	CT172	3801	811690.450	820169.984	黃花夾竹桃	Thevetia peruviana	110	5	8	FELL	FELL	FELL	
3801	CT173	3801	811676.672	820172.436	台灣相思	Acacia confusa	180	9	16	FELL	FELL	FELL	
3801	CT176	3801	811672.992	820174.377	台灣相思	Acacia confusa	210	7	16	FELL	FELL	FELL	
3801	CT177	3801	811671.350	820175.099	台灣相思	Acacia confusa	140	6	16	FELL	FELL	FELL	
3801	CT178	3801	811671.995	820172.922	羊蹄甲屬	Bauhinia spp.	110	7	9	FELL	FELL	FELL	
3801	CT179	3801	811669.648	820173.002	台灣相思	Acacia confusa	170	6	14	FELL	FELL	FELL	
3801	CT180	3801	811666.364	820175.308	台灣相思	Acacia confusa	180	7	16	FELL	FELL	FELL	
3801	CT181	3801	811665.456	820174.386	台灣相思	Acacia confusa	110	5	13	FELL	FELL	FELL	
3801	CT182	3801	811660.177	820171.247	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT183	3801	811658.475	820166.754	大葉相思	Acacia mangium	250	9	10	FELL	FELL	FELL	
3801	CT184	3801	811657.574	820166.492	大葉相思	Acacia mangium	220	6	10	FELL	FELL	FELL	
3801	CT1843	AAHK	811391.635	817613.111	細葉榕	Ficus microcarpa	310	3	6	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1844	AAHK	811390.606	817612.382	細葉榕	Ficus microcarpa	570	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1845	AAHK	811381.886	817624.303	細葉榕	Ficus microcarpa	520	4	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1846	AAHK	811382.300	817634.589	細葉榕	Ficus microcarpa	410	4	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1847	AAHK	811380.899	817640.183	細葉榕	Ficus microcarpa	590	4	6	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1848	AAHK	811378.905	817645.662	細葉榕	Ficus microcarpa	480	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1849	AAHK	811372.259	817656.310	細葉榕	Ficus microcarpa	320	4	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT185	3801	811657.255	820165.399	大葉相思	Acacia mangium	230	6	10	FELL	FELL	FELL	
3801	CT1850	AAHK	811363.127	817671.363	細葉榕	Ficus microcarpa	370	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1851	AAHK	811363.547	817681.440	細葉榕	Ficus microcarpa	450	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1852	AAHK	811359.624	817692.088	細葉榕	Ficus microcarpa	420	4	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1853	AAHK	811354.966	817706.226	細葉榕	Ficus microcarpa	380	3	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1855	AAHK	811343.868	817780.938	羊蹄甲屬	Bauhinia spp.	290	4	3	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in May 2022.
3801	CT1856	AAHK	811343.087	817775.999	藍花楸	Jacaranda mimosifolia	210	5	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in May 2022.
3801	CT1857	AAHK	811347.770	817768.980	羊蹄甲屬	Bauhinia spp.	280	7	6	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in May 2022.
3801	CT1859	3801	811354.794	817740.366	羊蹄甲屬	Bauhinia spp.	230	4	7	RETAIN	Excluded from the Project	Excluded from the Project	
3801	CT186	3801	811657.592	820164.354	大葉相思	Acacia mangium	150	5	9	FELL	FELL	FELL	
3801	CT1860	AAHK	811356.875	817729.968	羊蹄甲屬	Bauhinia spp.	110	2	4	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1861	AAHK	811357.838	817726.588	銀合歡	Leucaena leucocephala	130	3	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1862	AAHK	811359.575	817718.314	羊蹄甲屬	Bauhinia spp.	180	4	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1865	AAHK	811363.236	817705.666	羊蹄甲屬	Bauhinia spp.	240	3	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1866	AAHK	811364.495	817701.562	羊蹄甲屬	Bauhinia spp.	230	4	10	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1867	AAHK	811366.029	817697.454	羊蹄甲屬	Bauhinia spp.	270	5	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1868	AAHK	811367.453	817693.620	羊蹄甲屬	Bauhinia spp.	260	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1869	AAHK	811368.603	817689.845	羊蹄甲屬	Bauhinia spp.	280	4	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT187	3801	811656.760	820166.104	大葉相思	Acacia mangium	120	5	7	FELL	FELL	FELL	
3801	CT1870	AAHK	811367.667	817686.011	藍花楸	Jacaranda mimosifolia	160	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1871	AAHK	811371.082	817683.385	紅花羊蹄甲	Bauhinia purpurea	180	6	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1872	AAHK	811372.396	817679.098	紅花羊蹄甲	Bauhinia purpurea	220	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1873	AAHK	811373.915	817674.713	羊蹄甲屬	Bauhinia spp.	160	1	5	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1874	AAHK	811383.723	817650.311	洋紫荊	Bauhinia x blakeana	180	6	7	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1876	AAHK	811399.008	817618.562	羊蹄甲屬	Bauhinia spp.	230	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1877	AAHK	811402.845	817611.179	紅花羊蹄甲	Bauhinia purpurea	200	4	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT1878	AAHK	811405.603	817606.686	紅花羊蹄甲	Bauhinia purpurea	240	5	8	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Oct 2021.
3801	CT188	3801	811647.477	820168.303	台灣相思	Acacia confusa	130	7	10	FELL	FELL	FELL	
3801	CT1888	3802	811428.848	820134.355	細葉榕	Ficus microcarpa	300	6	8	RETAIN	FELL	FELL	
3801	CT189	3801	811648.680	820169.098	台灣相思	Acacia confusa	160	8	10	FELL	FELL	FELL	
3801	CT1891	3801	811421.766	820122.939	台灣相思	Acacia confusa	110	4	7	FELL	FELL	FELL	
3801	CT190	3801	811646.837	820168.898	台灣相思	Acacia confusa	130	5	9	FELL	FELL	FELL	
3801	CT1903	3801	811412.345	820118.269	耳果相思	Acacia auriculiformis	200	6	14	FELL	FELL	FELL	
3801	CT191	3801	811645.828	820169.164	台灣相思	Acacia confusa	180	7	10	FELL	FELL	FELL	
3801	CT1915	3801	811410.772	820117.821	台灣相思	Acacia confusa	110	6	11	FELL	FELL	FELL	
3801	CT1918	3801	811409.481	820113.127	羊蹄甲屬	Bauhinia spp.	110	6	8	FELL	FELL	FELL	
3801	CT1919	3801	811411.271	820111.204	黃槿	Hibiscus tiliaceus	155	7	8	FELL	FELL	FELL	
3801	CT192	3801	811644.947	820169.518	台灣相思	Acacia confusa	120	6	8	FELL	FELL	FELL	
3801	CT1920	3801	811406.304	820113.529	紅膠木	Lophostemon confertus	160	5	11	FELL	FELL	FELL	
3801	CT1921	3801	811405.857	820115.854	紅膠木	Lophostemon confertus	170	6	12	FELL	FELL	FELL	
3801	CT1922	3801	811403.620	820113.931	台灣相思	Acacia confusa	110	1	11	FELL	FELL	FELL	
3801	CT1923	3801	811403.396	820113.484	台灣相思	Acacia confusa	110	5	12	FELL	FELL	FELL	
3801	CT1924	3801	811400.089	820111.096	黃槿	Hibiscus tiliaceus	145	4	8	FELL	FELL	FELL	
3801	CT1925	3801	811399.866	820112.200	黃槿	Hibiscus tiliaceus	130	6	9	FELL	FELL	FELL	
3801	CT1926	3801	811398.996	820112.052	黃槿	Hibiscus tiliaceus	115	6	9	FELL	FELL	FELL	
3801	CT1927	3801	811399.271	820112.690	台灣相思	Acacia confusa	150	6	12	FELL	FELL	FELL	
3801	CT1928	3801	811398.235	820112.583	台灣相思	Acacia confusa	170	5	12	FELL	FELL	FELL	
3801	CT1929	3801	811396.943	820112.368	台灣相思	Acacia confusa	200	7	12	FELL	FELL	FELL	
3801	CT193	3801	811643.239	820169.055	黃槿	Hibiscus tiliaceus	100	6	4	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1930	3801	811397.720	820111.779	黃槿	Hibiscus tiliaceus	200	6	11	FELL	FELL	FELL	
3801	CT1931	3801	811396.582	820111.552	黃槿	Hibiscus tiliaceus	210	6	11	FELL	FELL	FELL	
3801	CT1932	3801	811395.944	820111.552	黃槿	Hibiscus tiliaceus	283	7	13	FELL	FELL	FELL	
3801	CT194	3801	811647.099	820170.705	紅膠木	Lophostemon confertus	110	6	7	FELL	FELL	FELL	
3801	CT195	3801	811648.907	820170.951	紅膠木	Lophostemon confertus	120	5	9	FELL	FELL	FELL	
3801	CT196	3801	811656.047	820174.360	台灣相思	Acacia confusa	300	8	13	FELL	FELL	FELL	
3801	CT197	3801	811658.662	820177.947	苦楝	Melia azedarach	230	7	13	FELL	FELL	FELL	
3801	CT198	3801	811660.299	820178.993	台灣相思	Acacia confusa	130	6	10	FELL	FELL	FELL	
3801	CT199	3801	811657.880	820179.319	台灣相思	Acacia confusa	130	5	13	FELL	FELL	FELL	
3801	CT200	3801	811655.969	820178.959	台灣相思	Acacia confusa	100	3	10	FELL	FELL	FELL	
3801	CT201	3801	811655.786	820180.102	耳果相思	Acacia auriculiformis	180	6	14	FELL	FELL	FELL	
3801	CT202	3801	811652.113	820182.405	大葉相思	Acacia mangium	230	6	14	FELL	FELL	FELL	
3801	CT203	3801	811650.822	820177.183	銀合歡	Leucaena leucocephala	110	5	12	FELL	FELL	FELL	
3801	CT204	3801	811646.331	820176.852	台灣相思	Acacia confusa	150	7	11	FELL	FELL	FELL	
3801	CT205	3801	811645.269	820177.900	台灣相思	Acacia confusa	120	7	13	FELL	FELL	FELL	
3801	CT206	3801	811644.245	820178.156	台灣相思	Acacia confusa	170	8	15	FELL	FELL	FELL	
3801	CT207	3801	811644.127	820181.841	台灣相思	Acacia confusa	140	7	14	FELL	FELL	FELL	
3801	CT208	3801	811647.929	820181.165	台灣相思	Acacia confusa	130	5	14	FELL	FELL	FELL	
3801	CT209	3801	811648.879	820181.789	台灣相思	Acacia confusa	120	4	15	FELL	FELL	FELL	
3801	CT210	3801	811646.912	820182.868	台灣相思	Acacia confusa	130	4	14	FELL	FELL	FELL	
3801	CT212	3801	811645.445	820184.991	台灣相思	Acacia confusa	120	5	12	FELL	FELL	FELL	
3801	CT213	3801	811645.095	820186.558	台灣相思	Acacia confusa	140	5	12	FELL	FELL	FELL	
3801	CT214	3801	811643.149	820186.397	青果榕	Ficus variegata	220	8	15	FELL	FELL	FELL	
3801	CT217	3801	811639.417	820188.072	台灣相思	Acacia confusa	170	6	11	FELL	FELL	FELL	
3801	CT218	3801	811636.965	820188.049	台灣相思	Acacia confusa	150	5	11	FELL	FELL	FELL	
3801	CT219	3801	811640.292	820184.068	台灣相思	Acacia confusa	140	5	12	FELL	FELL	FELL	
3801	CT220	3801	811641.476	820182.823	台灣相思	Acacia confusa	120	6	13	FELL	FELL	FELL	
3801	CT221	3801	811639.794	820181.531	台灣相思	Acacia confusa	130	6	13	FELL	FELL	FELL	
3801	CT222	3801	811639.073	820180.793	台灣相思	Acacia confusa	112	5	13	FELL	FELL	FELL	
3801	CT223	3801	811637.328	820181.255	台灣相思	Acacia confusa	130	7	12	FELL	FELL	FELL	
3801	CT224	3801	811636.552	820182.481	台灣相思	Acacia confusa	180	8	12	FELL	FELL	FELL	
3801	CT225	3801	811638.424	820179.225	台灣相思	Acacia confusa	249	8	12	FELL	FELL	FELL	
3801	CT226	3801	811638.866	820172.737	紅膠木	Lophostemon confertus	120	5	9	FELL	FELL	FELL	
3801	CT227	3801	811637.149	820173.115	紅膠木	Lophostemon confertus	110	4	8	FELL	FELL	FELL	
3801	CT228	3801	811635.727	820172.814	台灣相思	Acacia confusa	160	7	10	FELL	FELL	FELL	
3801	CT229	3801	811634.606	820175.087	黃槿	Hibiscus tiliaceus	110	5	7	FELL	FELL	FELL	
3801	CT230	3801	811633.556	820175.201	黃槿	Hibiscus tiliaceus	100	5	6	FELL	FELL	FELL	
3801	CT231	3801	811632.835	820174.508	紅膠木	Lophostemon confertus	110	7	6	FELL	FELL	FELL	
3801	CT232	3801	811629.994	820175.478	紅膠木	Lophostemon confertus	100	4	5	FELL	FELL	FELL	
3801	CT233	3801	811628.890	820172.596	苦楝	Melia azedarach	150	6	7	FELL	FELL	FELL	
3801	CT234	3801	811627.992	820173.085	苦楝	Melia azedarach	130	5	8	FELL	FELL	FELL	
3801	CT235	3801	811627.127	820173.390	台灣相思	Acacia confusa	120	4	8	FELL	FELL	FELL	
3801	CT236	3801	811626.228	820173.720	台灣相思	Acacia confusa	160	7	9	FELL	FELL	FELL	
3801	CT237	3801	811625.334	820174.019	台灣相思	Acacia confusa	261	8	10	FELL	FELL	FELL	
3801	CT238	3801	811625.774	820175.690	台灣相思	Acacia confusa	130	6	9	FELL	FELL	FELL	
3801	CT239	3801	811627.687	820175.277	台灣相思	Acacia confusa	140	5	9	FELL	FELL	FELL	
3801	CT240	3801	811626.430	820178.005	大葉相思	Acacia mangium	140	2	10	FELL	FELL	FELL	
3801	CT241	3801	811627.306	820178.934	大葉相思	Acacia mangium	200	4	10	FELL	FELL	FELL	
3801	CT242	3801	811634.271	820182.916	死樹	Dead tree	100	6	4	FELL	FELL	FELL	
3801	CT243	3801	811627.061	820182.529	苦楝	Melia azedarach	220	8	9	FELL	FELL	FELL	
3801	CT244	3801	811625.027	820183.954	台灣相思	Acacia confusa	158	5	9	FELL	FELL	FELL	
3801	CT245	3801	811623.381	820183.302	台灣相思	Acacia confusa	100	5	8	FELL	FELL	FELL	
3801	CT246	3801	811622.449	820183.456	台灣相思	Acacia confusa	130	5	11	FELL	FELL	FELL	
3801	CT247	3801	811622.881	820185.972	苦楝	Melia azedarach	260	9	10	FELL	FELL	FELL	
3801	CT248	3801	811626.322	820187.588	台灣相思	Acacia confusa	130	6	11	FELL	FELL	FELL	
3801	CT249	3801	811627.316	820187.632	台灣相思	Acacia confusa	140	6	12	FELL	FELL	FELL	
3801	CT250	3801	811626.093	820188.988	台灣相思	Acacia confusa	110	5	10	FELL	FELL	FELL	
3801	CT251	3801	811628.441	820189.007	台灣相思	Acacia confusa	100	6	9	FELL	FELL	FELL	
3801	CT252	3801	811629.038	820188.473	台灣相思	Acacia confusa	100	4	14	FELL	FELL	FELL	
3801	CT253	3801	811628.994	820187.277	台灣相思	Acacia confusa	190	9	15	FELL	FELL	FELL	
3801	CT254	3801	811634.744	820190.433	台灣相思	Acacia confusa	162	6	9	FELL	FELL	FELL	
3801	CT255	3801	811627.857	820192.216	大葉相思	Acacia mangium	350	10	14	FELL	FELL	FELL	
3801	CT256	3801	811620.891	820192.285	台灣相思	Acacia confusa	130	6	10	FELL	FELL	FELL	
3801	CT257	3801	811620.248	820191.642	台灣相思	Acacia confusa	110	5	5	FELL	FELL	FELL	
3801	CT258	3801	811618.360	820191.8	台灣相思	Acacia confusa	230	8	13	FELL	FELL	FELL	
3801	CT259	3801	811616.201	820189.564	台灣相思	Acacia confusa	160	8	13	FELL	FELL	FELL	
3801	CT260	3801	811617.578	820188.518	台灣相思	Acacia confusa	150	6	11	FELL	FELL	FELL	
3801	CT261	3801	811616.667	820188.642	台灣相思	Acacia confusa	198	4	12	FELL	FELL	FELL	
3801	CT262	3801	811616.286	820186.763	台灣相思	Acacia confusa	156	5	14	FELL	FELL	FELL	
3801	CT263	3801	811615.407	820186.922	台灣相思	Acacia confusa	120	6	12	FELL	FELL	FELL	
3801	CT264	3801	811612.672	820191.971	苦楝	Melia azedarach	220	7	10	FELL	FELL	FELL	
3801	CT265	3801	811608.837	820192.214	黃槿	Hibiscus tiliaceus	130	9	8	FELL	FELL	FELL	
3801	CT266	3801	811607.771	820192.352	黃槿	Hibiscus tiliaceus	110	7	9	FELL	FELL	FELL	
3801	CT267	3801	811605.940	820196.44	台灣相思	Acacia confusa	180	10	9	FELL	FELL	FELL	
3801	CT268	3801	811603.780	820194.29	耳果相思	Acacia auriculiformis	310	5	13	FELL	FELL	FELL	
3801	CT269	3801	811603.510	820195.09	耳果相思	Acacia auriculiformis	249	5	13	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT27	3801	811752.679	820070.061	台灣相思	Acacia confusa	120	6	5	FELL	FELL	FELL	
3801	CT270	3801	811602.800	820202.900	台灣相思	Acacia confusa	156	6	10	FELL	FELL	FELL	
3801	CT271	3801	811602.570	820204.130	台灣相思	Acacia confusa	177	8	10	FELL	FELL	FELL	
3801	CT272	3801	811601.180	820204.200	台灣相思	Acacia confusa	177	8	10	FELL	FELL	FELL	
3801	CT273	3801	811595.900	820198.76	苦楝	Melia azedarach	290	7	10	FELL	FELL	FELL	
3801	CT274	3801	811596.800	820196.99	苦楝	Melia azedarach	160	6	9	FELL	FELL	FELL	
3801	CT275	3801	811595.840	820197.14	苦楝	Melia azedarach	240	6	11	FELL	FELL	FELL	
3801	CT276	SLPS	811595.260	820197.820	苦楝	Melia azedarach	100	5	5	TRANSPLANT	TRANSPLANTED	TRANSPLANTED	
3801	CT277	3801	811593.710	820196.84	苦楝	Melia azedarach	240	7	11	FELL	FELL	FELL	
3801	CT278	3801	811593.220	820197.56	台灣相思	Acacia confusa	100	4	4	FELL	FELL	FELL	
3801	CT279	3801	811592.440	820195.41	大葉相思	Acacia mangium	470	8	15	FELL	FELL	FELL	
3801	CT28	3801	811749.735	820076.922	台灣相思	Acacia confusa	110	6	10	FELL	FELL	FELL	
3801	CT280	3801	811588.930	820194.17	苦楝	Melia azedarach	220	5	15	FELL	FELL	FELL	
3801	CT281	3801	811590.545	820190.559	台灣相思	Acacia confusa	170	8	13	FELL	FELL	FELL	
3801	CT282	3801	811590.413	820189.831	台灣相思	Acacia confusa	110	4	4	FELL	FELL	FELL	
3801	CT283	3801	811591.912	820189.888	台灣相思	Acacia confusa	130	8	13	FELL	FELL	FELL	
3801	CT284	3801	811592.465	820190.999	台灣相思	Acacia confusa	150	6	14	FELL	FELL	FELL	
3801	CT285	3801	811593.309	820192.003	台灣相思	Acacia confusa	170	6	14	FELL	FELL	FELL	
3801	CT286	3801	811597.544	820189.239	苦楝	Melia azedarach	410	15	14	FELL	FELL	FELL	
3801	CT287	3801	811598.413	820188.294	台灣相思	Acacia confusa	110	6	6	FELL	FELL	FELL	
3801	CT288	3801	811599.048	820187.264	台灣相思	Acacia confusa	160	5	12	FELL	FELL	FELL	
3801	CT289	3801	811599.833	820186.409	台灣相思	Acacia confusa	130	7	4	FELL	FELL	FELL	
3801	CT29	3801	811748.524	820077.019	台灣相思	Acacia confusa	230	6	9	FELL	FELL	FELL	
3801	CT290	3801	811600.576	820186.269	台灣相思	Acacia confusa	226	6	14	FELL	FELL	FELL	
3801	CT292	3801	811602.567	820188.954	黃槿	Hibiscus tiliaceus	120	5	7	FELL	FELL	FELL	
3801	CT293	3801	811610.278	820183.583	台灣相思	Acacia confusa	150	6	13	FELL	FELL	FELL	
3801	CT294	3801	811610.664	820182.520	台灣相思	Acacia confusa	160	8	13	FELL	FELL	FELL	
3801	CT295	3801	811613.009	820183.408	台灣相思	Acacia confusa	110	2	10	FELL	FELL	FELL	
3801	CT296	3801	811615.405	820179.992	台灣相思	Acacia confusa	140	7	12	FELL	FELL	FELL	
3801	CT297	3801	811616.217	820179.134	台灣相思	Acacia confusa	150	8	12	FELL	FELL	FELL	
3801	CT298	3801	811618.344	820180.692	台灣相思	Acacia confusa	130	4	10	FELL	FELL	FELL	
3801	CT299	3801	811618.669	820179.628	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT30	3801	811749.506	820077.887	台灣相思	Acacia confusa	180	5	9	FELL	FELL	FELL	
3801	CT300	3801	811617.973	820179.118	台灣相思	Acacia confusa	222	7	10	FELL	FELL	FELL	
3801	CT301	3801	811613.979	820174.946	台灣相思	Acacia confusa	120	4	7	FELL	FELL	FELL	
3801	CT302	3801	811608.407	820175.061	潺槁樹	Litsea glutinosa	110	5	5	FELL	FELL	FELL	
3801	CT303	3801	811606.791	820175.354	台灣相思	Acacia confusa	170	7	9	FELL	FELL	FELL	
3801	CT304	3801	811605.578	820176.479	台灣相思	Acacia confusa	140	7	9	FELL	FELL	FELL	
3801	CT305	3801	811607.000	820178.026	紅膠木	Lophostemon confertus	110	4	8	FELL	FELL	FELL	
3801	CT306	3801	811608.708	820177.804	紅膠木	Lophostemon confertus	160	5	9	FELL	FELL	FELL	
3801	CT307	3801	811609.093	820179.437	紅膠木	Lophostemon confertus	110	5	9	FELL	FELL	FELL	
3801	CT308	3801	811609.490	820180.219	紅膠木	Lophostemon confertus	110	5	9	FELL	FELL	FELL	
3801	CT31	3801	811751.161	820077.486	苦楝	Melia azedarach	180	6	7	FELL	FELL	FELL	
3801	CT310	3801	811605.323	820181.508	黃槿	Hibiscus tiliaceus	110	5	8	FELL	FELL	FELL	
3801	CT311	3801	811600.991	820178.702	台灣相思	Acacia confusa	180	8	12	FELL	FELL	FELL	
3801	CT312	3801	811598.721	820180.011	半輪甲屬	Bauhinia spp.	100	4	5	FELL	FELL	FELL	
3801	CT313	3801	811598.031	820178.956	苦楝	Melia azedarach	210	8	9	FELL	FELL	FELL	
3801	CT314	3801	811598.059	820177.339	苦楝	Melia azedarach	200	8	7	FELL	FELL	FELL	
3801	CT315	3801	811598.245	820175.703	大葉相思	Acacia mangium	180	8	9	FELL	FELL	FELL	
3801	CT316	3801	811596.075	820176.511	台灣相思	Acacia confusa	100	4	5	FELL	FELL	FELL	
3801	CT317	3801	811595.119	820180.506	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT318	3801	811600.488	820183.166	大葉相思	Acacia mangium	120	10	4	FELL	FELL	FELL	
3801	CT319	3801	811589.055	820183.051	黃槿	Hibiscus tiliaceus	180	8	10	FELL	FELL	FELL	
3801	CT32	3801	811750.827	820079.902	苦楝	Melia azedarach	230	6	11	FELL	FELL	FELL	
3801	CT320	3801	811588.532	820181.949	黃槿	Hibiscus tiliaceus	100	5	5	FELL	FELL	FELL	
3801	CT321	3801	811588.774	820183.646	黃槿	Hibiscus tiliaceus	120	5	10	FELL	FELL	FELL	
3801	CT322	3801	811590.517	820183.644	台灣相思	Acacia confusa	100	4	9	FELL	FELL	FELL	
3801	CT323	3801	811588.233	820186.440	台灣相思	Acacia confusa	140	4	12	FELL	FELL	FELL	
3801	CT324	3801	811587.510	820186.455	台灣相思	Acacia confusa	170	6	12	FELL	FELL	FELL	
3801	CT325	3801	811586.351	820186.221	台灣相思	Acacia confusa	160	8	12	FELL	FELL	FELL	
3801	CT326	3801	811584.605	820185.869	台灣相思	Acacia confusa	100	7	11	FELL	FELL	FELL	
3801	CT327	3801	811587.177	820184.553	台灣相思	Acacia confusa	100	5	9	FELL	FELL	FELL	
3801	CT328	3801	811586.244	820184.265	台灣相思	Acacia confusa	130	6	14	FELL	FELL	FELL	
3801	CT329	3801	811585.496	820184.249	台灣相思	Acacia confusa	100	4	12	FELL	FELL	FELL	
3801	CT33	3801	811749.556	820079.688	苦楝	Melia azedarach	260	10	10	FELL	FELL	FELL	
3801	CT330	3801	811586.581	820183.557	黃槿	Hibiscus tiliaceus	170	8	10	FELL	FELL	FELL	
3801	CT331	3801	811587.165	820181.696	黃槿	Hibiscus tiliaceus	100	7	7	FELL	FELL	FELL	
3801	CT332	3801	811583.918	820180.155	大葉相思	Acacia mangium	140	4	12	FELL	FELL	FELL	
3801	CT333	3801	811584.895	820179.336	大葉相思	Acacia mangium	210	6	11	FELL	FELL	FELL	
3801	CT334	3801	811581.583	820176.857	黃槿	Hibiscus tiliaceus	180	8	10	FELL	FELL	FELL	
3801	CT335	3801	811580.963	820175.778	黃槿	Hibiscus tiliaceus	200	9	9	FELL	FELL	FELL	
3801	CT336	3801	811579.604	820175.243	黃槿	Hibiscus tiliaceus	120	7	8	FELL	FELL	FELL	
3801	CT337	3801	811577.501	820175.575	苦楝	Melia azedarach	180	7	10	FELL	FELL	FELL	
3801	CT338	3801	811580.583	820180.042	紅膠木	Lophostemon confertus	100	4	10	FELL	FELL	FELL	
3801	CT339	3801	811580.319	820182.740	台灣相思	Acacia confusa	140	7	11	FELL	FELL	FELL	
3801	CT34	3801	811748.574	820079.676	台灣相思	Acacia confusa	170	6	9	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT340	3801	811579.356	820183.553	台灣相思	Acacia confusa	110	7	5	FELL	FELL		
3801	CT341	3801	811577.983	820182.648	台灣相思	Acacia confusa	150	8	12	FELL	FELL		
3801	CT342	3801	811576.174	820181.160	耳果相思	Acacia auriculiformis	130	4	9	FELL	FELL		
3801	CT343	3801	811580.652	820183.828	台灣相思	Acacia confusa	130	7	12	FELL	FELL		
3801	CT344	3801	811579.769	820184.596	台灣相思	Acacia confusa	170	8	12	FELL	FELL		
3801	CT345	3801	811579.003	820185.295	台灣相思	Acacia confusa	170	7	3	FELL	FELL		
3801	CT347	3801	811571.962	820182.147	黃槿	Hibiscus tiliaceus	140	8	7	FELL	FELL		
3801	CT347A	3801	811569.712	820181.571	黃槿	Hibiscus tiliaceus	110	7	8	FELL	FELL		
3801	CT348	3801	811570.618	820176.739	黃槿	Hibiscus tiliaceus	120	5	5	FELL	FELL		
3801	CT348A	3801	811570.306	820180.994	黃槿	Hibiscus tiliaceus	110	7	8	FELL	FELL		
3801	CT349	3801	811571.688	820176.833	黃槿	Hibiscus tiliaceus	120	5	7	FELL	FELL		
3801	CT35	3801	811747.949	820078.950	台灣相思	Acacia confusa	130	6	9	FELL	FELL		
3801	CT350	3801	811571.441	820176.083	黃槿	Hibiscus tiliaceus	140	6	8	FELL	FELL		
3801	CT351	3801	811572.443	820173.627	苦楝	Melia azedarach	180	6	9	FELL	FELL		
3801	CT352	3801	811569.070	820173.973	紅膠木	Lophostemon confertus	120	5	8	FELL	FELL		
3801	CT353	3801	811568.271	820174.479	紅膠木	Lophostemon confertus	180	8	13	FELL	FELL		
3801	CT354	3801	811566.584	820173.781	台灣相思	Acacia confusa	130	8	14	FELL	FELL		
3801	CT355	3801	811566.157	820174.421	台灣相思	Acacia confusa	160	7	14	FELL	FELL		
3801	CT356	3801	811565.050	820176.274	台灣相思	Acacia confusa	190	9	11	FELL	FELL		
3801	CT356A	3801	811563.000	820174.348	黃花夾竹桃	Thevetia peruviana	120	5	5	FELL	FELL		
3801	CT357	3801	811562.290	820169.075	黃槿	Hibiscus tiliaceus	100	7	5	FELL	FELL		
3801	CT358	3801	811561.220	820169.530	黃槿	Hibiscus tiliaceus	130	6	6	FELL	FELL		
3801	CT359	3801	811562.410	820166.168	黃槿	Hibiscus tiliaceus	180	7	9	FELL	FELL		
3801	CT36	3801	811748.387	820082.323	台灣相思	Acacia confusa	110	6	7	FELL	FELL		
3801	CT360	3801	811563.474	820167.774	黃槿	Hibiscus tiliaceus	100	5	4	FELL	FELL		
3801	CT361	3801	811557.571	820164.222	黃槿	Hibiscus tiliaceus	200	9	10	FELL	FELL		
3801	CT362	3801	811556.710	820163.534	黃槿	Hibiscus tiliaceus	170	8	9	FELL	FELL		
3801	CT363	3801	811556.379	820166.009	台灣相思	Acacia confusa	150	7	11	FELL	FELL		
3801	CT364	3801	811556.397	820169.840	黃槿	Hibiscus tiliaceus	170	7	10	FELL	FELL		
3801	CT365	3801	811556.338	820170.816	黃槿	Hibiscus tiliaceus	230	10	10	FELL	FELL		
3801	CT366	3801	811554.484	820168.727	黃槿	Hibiscus tiliaceus	110	4	7	FELL	FELL		
3801	CT369	3801	811545.411	820159.783	台灣相思	Acacia confusa	120	7	7	FELL	FELL		
3801	CT369A	3801	811546.329	820157.769	黃花夾竹桃	Thevetia peruviana	120	5	5	FELL	FELL		
3801	CT37	3801	811750.258	820081.748	台灣相思	Acacia confusa	150	5	6	FELL	FELL		
3801	CT370	3801	811539.719	820144.976	黃槿	Hibiscus tiliaceus	150	5	9	FELL	FELL		
3801	CT371	3801	811540.311	820145.315	死樹	Dead tree	160	5	9	FELL	FELL		
3801	CT372	3801	811542.162	820144.061	苦楝	Melia azedarach	170	8	12	FELL	FELL		
3801	CT373	3801	811541.862	820141.012	苦楝	Melia azedarach	110	5	9	FELL	FELL		
3801	CT374	3801	811541.995	820140.255	苦楝	Melia azedarach	150	5	9	FELL	FELL		
3801	CT375	3801	811540.395	820138.731	台灣相思	Acacia confusa	140	7	10	FELL	FELL		
3801	CT376	3801	811539.691	820138.373	台灣相思	Acacia confusa	100	2	4	FELL	FELL		
3801	CT377	3801	811540.038	820137.499	台灣相思	Acacia confusa	140	5	13	FELL	FELL		
3801	CT378	3801	811541.467	820138.117	台灣相思	Acacia confusa	160	6	10	FELL	FELL		
3801	CT379	3801	811542.477	820136.790	台灣相思	Acacia confusa	130	7	9	FELL	FELL		
3801	CT37A	3801	811749.695	820082.564	台灣相思	Acacia confusa	110	5	5	FELL	FELL		
3801	CT38	3801	811747.748	820087.335	台灣相思	Acacia confusa	160	5	5	FELL	FELL		
3801	CT380	3801	811541.016	820135.756	黃槿	Hibiscus tiliaceus	180	6	10	FELL	FELL		
3801	CT381	3801	811541.415	820135.206	黃槿	Hibiscus tiliaceus	277	8	11	FELL	FELL		
3801	CT382	3801	811544.472	820136.937	大葉相思	Acacia mangium	200	7	13	FELL	FELL		
3801	CT383	3801	811545.009	820136.290	大葉相思	Acacia mangium	150	5	11	FELL	FELL		
3801	CT384	3801	811546.860	820134.049	苦楝	Melia azedarach	130	8	5	FELL	FELL		
3801	CT385	3801	811547.407	820133.621	苦楝	Melia azedarach	390	10	13	FELL	FELL		
3801	CT386	3801	811545.164	820131.244	苦楝	Melia azedarach	210	6	14	FELL	FELL		
3801	CT387	3801	811546.463	820129.222	黃槿	Hibiscus tiliaceus	220	6	9	FELL	FELL		
3801	CT388	3801	811549.776	820127.886	台灣相思	Acacia confusa	130	4	8	FELL	FELL		
3801	CT389	3801	811550.014	820127.527	苦楝	Melia azedarach	230	7	14	FELL	FELL		
3801	CT39	3801	811746.892	820087.273	台灣相思	Acacia confusa	200	6	9	FELL	FELL		
3801	CT390	3801	811550.829	820128.488	台灣相思	Acacia confusa	140	5	8	FELL	FELL		
3801	CT391	3801	811551.538	820127.006	苦楝	Melia azedarach	110	4	9	FELL	FELL		
3801	CT392	3801	811551.629	820128.109	台灣相思	Acacia confusa	260	9	15	FELL	FELL		
3801	CT393	3801	811552.278	820127.864	台灣相思	Acacia confusa	130	5	9	FELL	FELL		
3801	CT394	3801	811554.501	820126.665	苦楝	Melia azedarach	190	6	15	FELL	FELL		
3801	CT395	3801	811556.164	820124.991	苦楝	Melia azedarach	150	5	9	FELL	FELL		
3801	CT396	3801	811558.887	820124.196	苦楝	Melia azedarach	250	7	15	FELL	FELL		
3801	CT397	3801	811563.497	820122.778	台灣相思	Acacia confusa	160	7	10	FELL	FELL		
3801	CT398	3801	811563.466	820124.198	台灣相思	Acacia confusa	140	6	7	FELL	FELL		
3801	CT399	3801	811564.981	820123.600	台灣相思	Acacia confusa	140	6	10	FELL	FELL		
3801	CT40	3801	811744.787	820085.847	苦楝	Melia azedarach	240	7	8	FELL	FELL		
3801	CT400	3801	811564.628	820124.241	台灣相思	Acacia confusa	130	6	9	FELL	FELL		
3801	CT401	3801	811564.289	820125.226	台灣相思	Acacia confusa	150	9	13	FELL	FELL		
3801	CT402	3801	811565.217	820125.175	台灣相思	Acacia confusa	100	5	8	FELL	FELL		
3801	CT403	3801	811564.839	820126.036	台灣相思	Acacia confusa	120	5	12	FELL	FELL		
3801	CT404	3801	811562.956	820127.747	黃花夾竹桃	Thevetia peruviana	117	4	7	FELL	FELL		
3801	CT405	3801	811563.674	820127.654	黃花夾竹桃	Thevetia peruviana	100	3	9	FELL	FELL		
3801	CT406	3801	811565.776	820126.154	台灣相思	Acacia confusa	140	7	12	FELL	FELL		
3801	CT407	3801	811567.132	820127.264	黃花夾竹桃	Thevetia peruviana	136	4	9	FELL	FELL		

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT408	3801	811570.464	820127.440	黃花夾竹桃	<i>Thevetia peruviana</i>	146	3	7	FELL	FELL	FELL	
3801	CT409	3801	811573.813	820127.057	大葉相思	<i>Acacia mangium</i>	310	8	15	FELL	FELL	FELL	
3801	CT41	3801	811743.761	820089.377	苦楝	<i>Melia azedarach</i>	100	4	6	FELL	FELL	FELL	
3801	CT410	3801	811574.436	820127.371	銀合歡	<i>Leucaena leucocephala</i>	100	6	13	FELL	FELL	FELL	
3801	CT411	3801	811568.800	820121.917	大葉相思	<i>Acacia mangium</i>	160	8	14	FELL	FELL	FELL	
3801	CT412	3801	811577.448	820126.902	大葉相思	<i>Acacia mangium</i>	230	7	14	FELL	FELL	FELL	
3801	CT413	3801	811577.714	820127.244	大葉相思	<i>Acacia mangium</i>	140	5	15	FELL	FELL	FELL	
3801	CT414	3801	811581.792	820124.546	紅膠木	<i>Lophostemon confertus</i>	120	5	9	FELL	FELL	FELL	
3801	CT415	3801	811582.341	820125.869	羊蹄甲屬	<i>Bauhinia spp.</i>	130	7	9	FELL	FELL	FELL	
3801	CT416	3801	811583.838	820126.617	苦楝	<i>Melia azedarach</i>	160	6	15	FELL	FELL	FELL	
3801	CT417	3801	811584.964	820126.648	苦楝	<i>Melia azedarach</i>	150	6	12	FELL	FELL	FELL	
3801	CT418	3801	811585.571	820126.089	台灣相思	<i>Acacia confusa</i>	150	8	5	FELL	FELL	FELL	
3801	CT419	3801	811586.362	820126.210	台灣相思	<i>Acacia confusa</i>	140	9	13	FELL	FELL	FELL	
3801	CT42	3801	811746.165	820089.613	台灣相思	<i>Acacia confusa</i>	170	5	7	FELL	FELL	FELL	
3801	CT420	3801	811587.302	820126.117	台灣相思	<i>Acacia confusa</i>	170	5	11	FELL	FELL	FELL	
3801	CT421	3801	811588.630	820126.027	台灣相思	<i>Acacia confusa</i>	150	8	12	FELL	FELL	FELL	
3801	CT422	3801	811590.441	820126.009	台灣相思	<i>Acacia confusa</i>	150	9	12	FELL	FELL	FELL	
3801	CT423	3801	811590.945	820126.389	台灣相思	<i>Acacia confusa</i>	190	10	11	FELL	FELL	FELL	
3801	CT424	3801	811591.889	820125.298	台灣相思	<i>Acacia confusa</i>	100	5	6	FELL	FELL	FELL	
3801	CT425	3801	811592.963	820124.931	台灣相思	<i>Acacia confusa</i>	110	4	6	FELL	FELL	FELL	
3801	CT426	3801	811593.562	820125.921	台灣相思	<i>Acacia confusa</i>	160	10	14	FELL	FELL	FELL	
3801	CT427	3801	811593.957	820125.913	死樹	Dead tree	170	8	12	FELL	FELL	FELL	
3801	CT428	3801	811594.525	820125.174	台灣相思	<i>Acacia confusa</i>	170	11	13	FELL	FELL	FELL	
3801	CT429	3801	811599.937	820122.669	台灣相思	<i>Acacia confusa</i>	140	5	13	FELL	FELL	FELL	
3801	CT43	3801	811742.235	820095.116	台灣相思	<i>Acacia confusa</i>	206	8	8	FELL	FELL	FELL	
3801	CT430	3801	811604.440	820121.972	大葉相思	<i>Acacia mangium</i>	140	8	12	FELL	FELL	FELL	
3801	CT431	3801	811605.429	820122.065	大葉相思	<i>Acacia mangium</i>	210	9	13	FELL	FELL	FELL	
3801	CT432	3801	811606.256	820123.023	大葉相思	<i>Acacia mangium</i>	120	6	8	FELL	FELL	FELL	
3801	CT433	3801	811606.493	820122.058	大葉相思	<i>Acacia mangium</i>	160	5	11	FELL	FELL	FELL	
3801	CT434	3801	811607.521	820122.902	大葉相思	<i>Acacia mangium</i>	240	8	14	FELL	FELL	FELL	
3801	CT435	3801	811609.123	820122.279	苦楝	<i>Melia azedarach</i>	230	6	14	FELL	FELL	FELL	
3801	CT436	3801	811606.825	820126.286	羊蹄甲屬	<i>Bauhinia spp.</i>	130	7	8	FELL	FELL	FELL	
3801	CT437	3801	811608.822	820125.772	羊蹄甲屬	<i>Bauhinia spp.</i>	150	9	8	FELL	FELL	FELL	
3801	CT438	3801	811610.717	820125.653	羊蹄甲屬	<i>Bauhinia spp.</i>	120	5	10	FELL	FELL	FELL	
3801	CT439	3801	811611.915	820122.181	苦楝	<i>Melia azedarach</i>	210	7	13	FELL	FELL	FELL	
3801	CT44	3801	811742.018	820096.878	台灣相思	<i>Acacia confusa</i>	140	5	8	FELL	FELL	FELL	
3801	CT440	3801	811616.465	820121.391	台灣相思	<i>Acacia confusa</i>	230	7	10	FELL	FELL	FELL	
3801	CT441	3801	811618.568	820121.241	台灣相思	<i>Acacia confusa</i>	180	8	10	FELL	FELL	FELL	
3801	CT442	3801	811619.682	820121.146	台灣相思	<i>Acacia confusa</i>	110	4	6	FELL	FELL	FELL	
3801	CT443	3801	811623.012	820118.846	台灣相思	<i>Acacia confusa</i>	130	5	10	FELL	FELL	FELL	
3801	CT444	3801	811624.418	820119.154	紅膠木	<i>Lophostemon confertus</i>	110	5	7	FELL	FELL	FELL	
3801	CT445	3801	811621.031	820124.575	台灣相思	<i>Acacia confusa</i>	110	4	7	FELL	FELL	FELL	
3801	CT446	3801	811622.188	820124.470	台灣相思	<i>Acacia confusa</i>	160	8	10	FELL	FELL	FELL	
3801	CT447	3801	811625.011	820123.776	台灣相思	<i>Acacia confusa</i>	210	9	14	FELL	FELL	FELL	
3801	CT448	3801	811625.935	820123.460	台灣相思	<i>Acacia confusa</i>	130	8	13	FELL	FELL	FELL	
3801	CT449	3801	811626.961	820123.328	台灣相思	<i>Acacia confusa</i>	120	8	14	FELL	FELL	FELL	
3801	CT45	3801	811740.882	820098.639	台灣相思	<i>Acacia confusa</i>	130	5	7	FELL	FELL	FELL	
3801	CT450	3801	811627.752	820123.101	台灣相思	<i>Acacia confusa</i>	120	5	14	FELL	FELL	FELL	
3801	CT451	3801	811628.511	820122.961	台灣相思	<i>Acacia confusa</i>	220	9	15	FELL	FELL	FELL	
3801	CT452	3801	811630.122	820120.083	大葉相思	<i>Acacia mangium</i>	190	7	10	FELL	FELL	FELL	
3801	CT453	3801	811636.933	820117.605	台灣相思	<i>Acacia confusa</i>	190	8	11	FELL	FELL	FELL	
3801	CT454	3801	811637.853	820116.964	台灣相思	<i>Acacia confusa</i>	160	6	11	FELL	FELL	FELL	
3801	CT455	3801	811640.899	820116.177	耳果相思	<i>Acacia auriculiformis</i>	280	7	15	FELL	FELL	FELL	
3801	CT456	3801	811641.336	820116.099	大葉相思	<i>Acacia mangium</i>	190	5	12	FELL	FELL	FELL	
3801	CT457	3801	811640.144	820117.408	大葉相思	<i>Acacia mangium</i>	190	7	13	FELL	FELL	FELL	
3801	CT458	3801	811647.587	820116.440	羊蹄甲屬	<i>Bauhinia spp.</i>	120	6	7	FELL	FELL	FELL	
3801	CT459	3801	811650.024	820113.891	大葉相思	<i>Acacia mangium</i>	320	8	15	FELL	FELL	FELL	
3801	CT46	3801	811740.407	820098.008	台灣相思	<i>Acacia confusa</i>	170	6	9	FELL	FELL	FELL	
3801	CT460	3801	811650.238	820112.821	台灣相思	<i>Acacia confusa</i>	200	6	8	FELL	FELL	FELL	
3801	CT461	3801	811651.801	820112.943	大葉相思	<i>Acacia mangium</i>	230	6	13	FELL	FELL	FELL	
3801	CT462	3801	811652.783	820110.938	台灣相思	<i>Acacia confusa</i>	170	2	5	FELL	FELL	FELL	
3801	CT463	3801	811655.205	820111.821	台灣相思	<i>Acacia confusa</i>	130	10	12	FELL	FELL	FELL	
3801	CT464	3801	811655.382	820110.962	台灣相思	<i>Acacia confusa</i>	100	5	5	FELL	FELL	FELL	
3801	CT465	3801	811656.252	820110.739	台灣相思	<i>Acacia confusa</i>	150	7	12	FELL	FELL	FELL	
3801	CT466	3801	811658.259	820111.001	羊蹄甲屬	<i>Bauhinia spp.</i>	100	2	7	FELL	FELL	FELL	
3801	CT467	3801	811657.594	820109.536	台灣相思	<i>Acacia confusa</i>	170	7	13	FELL	FELL	FELL	
3801	CT468	3801	811663.670	820106.670	台灣相思	<i>Acacia confusa</i>	280	8	14	FELL	FELL	FELL	
3801	CT469	3801	811664.861	820107.684	台灣相思	<i>Acacia confusa</i>	210	7	12	FELL	FELL	FELL	
3801	CT47	3801	811739.809	820097.621	台灣相思	<i>Acacia confusa</i>	166	6	7	FELL	FELL	FELL	
3801	CT470	3801	811668.850	820104.569	苦楝	<i>Melia azedarach</i>	190	8	15	FELL	FELL	FELL	
3801	CT471	3801	811671.853	820101.349	紅膠木	<i>Lophostemon confertus</i>	190	8	10	FELL	FELL	FELL	
3801	CT472	3801	811683.171	820096.999	大葉相思	<i>Acacia mangium</i>	300	8	14	FELL	FELL	FELL	
3801	CT473	3801	811684.071	820095.415	台灣相思	<i>Acacia confusa</i>	190	8	15	FELL	FELL	FELL	
3801	CT474	3801	811685.045	820093.647	台灣相思	<i>Acacia confusa</i>	170	7	15	FELL	FELL	FELL	
3801	CT475	3801	811686.829	820095.120	蒴橘樹	<i>Litsea glutinosa</i>	100	3	5	FELL	FELL	FELL	
3801	CT476	3801	811687.830	820093.042	台灣相思	<i>Acacia confusa</i>	220	6	4	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT477	3801	811688.458	820091.561	台灣相思	Acacia confusa	250	11	14	FELL	FELL	FELL	
3801	CT478	3801	811689.519	820091.909	台灣相思	Acacia confusa	320	12	15	FELL	FELL	FELL	
3801	CT479	3801	811689.985	820094.007	黃花夾竹桃	Thevetia peruviana	100	5	8	FELL	FELL	FELL	
3801	CT480	3801	811691.131	820093.457	黃花夾竹桃	Thevetia peruviana	100	4	6	FELL	FELL	FELL	
3801	CT481	3801	811691.718	820092.772	黃花夾竹桃	Thevetia peruviana	110	7	6	FELL	FELL	FELL	
3801	CT482	3801	811691.930	820091.097	羊蹄甲屬	Bauhinia spp.	120	5	4	FELL	FELL	FELL	
3801	CT483	3801	811692.459	820089.034	黃槿	Hibiscus tiliaceus	130	5	9	FELL	FELL	FELL	
3801	CT484	3801	811694.017	820087.966	苦楝	Melia azedarach	270	5	16	FELL	FELL	FELL	
3801	CT485	3801	811694.423	820087.391	台灣相思	Acacia confusa	130	5	9	FELL	FELL	FELL	
3801	CT486	3801	811694.801	820088.751	羊蹄甲屬	Bauhinia spp.	130	8	6	FELL	FELL	FELL	
3801	CT487	3801	811695.713	820089.786	苦楝	Melia azedarach	320	8	13	FELL	FELL	FELL	
3801	CT488	3801	811697.804	820086.572	苦楝	Melia azedarach	280	9	11	FELL	FELL	FELL	
3801	CT489	3801	811698.732	820085.742	大葉相思	Acacia mangium	150	5	9	FELL	FELL	FELL	
3801	CT490	3801	811698.649	820085.337	大葉相思	Acacia mangium	480	10	15	FELL	FELL	FELL	
3801	CT491	3801	811698.397	820084.309	大葉相思	Acacia mangium	310	8	14	FELL	FELL	FELL	
3801	CT492	3801	811700.729	820082.547	大葉相思	Acacia mangium	110	2	8	FELL	FELL	FELL	
3801	CT493	3801	811701.690	820083.460	大葉相思	Acacia mangium	140	5	8	FELL	FELL	FELL	
3801	CT494	3801	811702.346	820082.617	大葉相思	Acacia mangium	230	8	14	FELL	FELL	FELL	
3801	CT495	3801	811701.812	820081.676	大葉相思	Acacia mangium	280	7	13	FELL	FELL	FELL	
3801	CT496	3801	811703.190	820082.497	大葉相思	Acacia mangium	170	6	13	FELL	FELL	FELL	
3801	CT497	3801	811704.000	820081.022	台灣相思	Acacia confusa	110	3	6	FELL	FELL	FELL	
3801	CT498	3801	811704.600	820080.461	台灣相思	Acacia confusa	160	7	12	FELL	FELL	FELL	
3801	CT499	3801	811705.521	820079.793	台灣相思	Acacia confusa	120	5	13	FELL	FELL	FELL	
3801	CT50	3801	811733.587	820104.750	羊蹄甲屬	Bauhinia spp.	130	5	5	FELL	FELL	FELL	
3801	CT500	3801	811705.686	820078.834	台灣相思	Acacia confusa	150	2	6	FELL	FELL	FELL	
3801	CT501	3801	811706.372	820081.647	台灣相思	Acacia confusa	226	7	12	FELL	FELL	FELL	
3801	CT501A	3801	811707.392	820080.549	台灣相思	Acacia confusa	110	6	10	FELL	FELL	FELL	
3801	CT502	3801	811707.000	820079.000	台灣相思	Acacia confusa	140	5	11	FELL	FELL	FELL	
3801	CT503	3801	811708.760	820077.670	台灣相思	Acacia confusa	227	8	13	FELL	FELL	FELL	
3801	CT504	3801	811709.981	820078.056	台灣相思	Acacia confusa	110	6	13	FELL	FELL	FELL	
3801	CT505	3801	811710.965	820077.751	台灣相思	Acacia confusa	184	8	15	FELL	FELL	FELL	
3801	CT506	3801	811715.970	820073.136	黃槿	Hibiscus tiliaceus	178	6	10	FELL	FELL	FELL	
3801	CT507	3801	811718.047	820071.040	黃槿	Hibiscus tiliaceus	110	7	6	FELL	FELL	FELL	
3801	CT508	3801	811713.210	820072.231	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT509	3801	811713.841	820072.123	台灣相思	Acacia confusa	156	5	10	FELL	FELL	FELL	
3801	CT51	3801	811735.070	820106.072	大葉相思	Acacia mangium	140	3	6	FELL	FELL	FELL	
3801	CT510	3801	811713.814	820071.502	台灣相思	Acacia confusa	120	5	9	FELL	FELL	FELL	
3801	CT511	3801	811714.260	820071.228	台灣相思	Acacia confusa	100	5	11	FELL	FELL	FELL	
3801	CT512	3801	811715.178	820070.421	台灣相思	Acacia confusa	180	5	12	FELL	FELL	FELL	
3801	CT513	3801	811715.650	820070.497	台灣相思	Acacia confusa	230	8	12	FELL	FELL	FELL	
3801	CT514	3801	811716.689	820069.425	台灣相思	Acacia confusa	110	5	8	FELL	FELL	FELL	
3801	CT515	3801	811718.195	820067.333	大葉相思	Acacia mangium	180	6	12	FELL	FELL	FELL	
3801	CT516	3801	811719.139	820067.499	大葉相思	Acacia mangium	270	9	13	FELL	FELL	FELL	
3801	CT517	3801	811719.954	820065.740	大葉相思	Acacia mangium	110	2	11	FELL	FELL	FELL	
3801	CT518	3801	811720.709	820065.931	大葉相思	Acacia mangium	150	4	12	FELL	FELL	FELL	
3801	CT519	3801	811721.150	820064.339	大葉相思	Acacia mangium	100	2	7	FELL	FELL	FELL	
3801	CT52	3801	811738.477	820108.984	銀合歡	Leucaena leucocephala	140	6	9	FELL	FELL	FELL	
3801	CT520	3801	811722.188	820064.339	大葉相思	Acacia mangium	160	4	10	FELL	FELL	FELL	
3801	CT521	3801	811721.725	820063.689	大葉相思	Acacia mangium	190	5	12	FELL	FELL	FELL	
3801	CT522	3801	811723.744	820061.349	台灣相思	Acacia confusa	100	2	5	FELL	FELL	FELL	
3801	CT523	3801	811725.635	820061.600	台灣相思	Acacia confusa	160	6	9	FELL	FELL	FELL	
3801	CT524	3801	811726.999	820061.395	苦楝	Melia azedarach	260	7	10	FELL	FELL	FELL	
3801	CT525	3801	811726.418	820059.608	紅膠木	Lophostemon confertus	120	3	5	FELL	FELL	FELL	
3801	CT526	3801	811727.427	820059.515	台灣相思	Acacia confusa	130	4	7	FELL	FELL	FELL	
3801	CT528	3801	811727.783	820058.111	台灣相思	Acacia confusa	180	8	12	FELL	FELL	FELL	
3801	CT529	3801	811728.910	820058.908	苦楝	Melia azedarach	220	5	12	FELL	FELL	FELL	
3801	CT53	3801	811736.538	820109.681	大葉相思	Acacia mangium	160	4	9	FELL	FELL	FELL	
3801	CT532	3801	811731.196	820053.918	大葉相思	Acacia mangium	120	5	9	FELL	FELL	FELL	
3801	CT533	3801	811732.426	820053.158	大葉相思	Acacia mangium	100	5	9	FELL	FELL	FELL	
3801	CT534	3801	811733.116	820053.205	大葉相思	Acacia mangium	250	6	12	FELL	FELL	FELL	
3801	CT535	3801	811734.510	820051.640	大葉相思	Acacia mangium	170	6	11	FELL	FELL	FELL	
3801	CT536	3801	811733.249	820050.840	大葉相思	Acacia mangium	190	5	10	FELL	FELL	FELL	
3801	CT537	3801	811737.093	820047.748	黃槿	Hibiscus tiliaceus	130	6	8	FELL	FELL	FELL	
3801	CT538	3801	811737.978	820045.486	大葉相思	Acacia mangium	260	9	12	FELL	FELL	FELL	
3801	CT539	3801	811740.969	820044.556	耳果相思	Acacia auriculiformis	100	5	9	FELL	FELL	FELL	
3801	CT54	3801	811735.914	820110.362	大葉相思	Acacia mangium	100	4	6	FELL	FELL	FELL	
3801	CT540	3801	811741.432	820040.669	台灣相思	Acacia confusa	200	10	10	FELL	FELL	FELL	
3801	CT541	3801	811743.035	820039.490	台灣相思	Acacia confusa	160	6	10	FELL	FELL	FELL	
3801	CT542	3801	811743.432	820038.589	台灣相思	Acacia confusa	180	7	11	FELL	FELL	FELL	
3801	CT543	3801	811742.825	820038.029	台灣相思	Acacia confusa	230	8	11	FELL	FELL	FELL	
3801	CT544	3801	811743.665	820037.876	台灣相思	Acacia confusa	190	7	10	FELL	FELL	FELL	
3801	CT545	3801	811739.268	820049.919	潺槁樹	Litsea glutinosa	150	5	6	FELL	FELL	FELL	
3801	CT546	3801	811741.343	820056.363	台灣相思	Acacia confusa	120	5	7	FELL	FELL	FELL	
3801	CT547	3801	811732.375	820058.426	潺槁樹	Litsea glutinosa	140	5	6	FELL	FELL	FELL	
3801	CT548	3801	811722.478	820073.696	苦楝	Melia azedarach	310	8	11	FELL	FELL	FELL	
3801	CT549	3801	811716.561	820079.409	苦楝	Melia azedarach	260	8	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT55	3801	811736.649	820111.144	大葉相思	Acacia mangium	280	5	11	FELL	FELL	FELL	
3801	CT555	3801	811695.021	820105.536	銀合歡	Leucaena leucocephala	162	4	12	FELL	FELL	FELL	
3801	CT556	3801	811693.206	820106.820	銀合歡	Leucaena leucocephala	162	6	13	FELL	FELL	FELL	
3801	CT557	3801	811685.459	820100.681	死樹	Dead tree	200	3	5	FELL	FELL	FELL	
3801	CT558	3801	811684.391	820104.330	死樹	Dead tree	170	3	4	FELL	FELL	FELL	
3801	CT559	3801	811684.993	820106.267	銀合歡	Leucaena leucocephala	135	6	14	FELL	FELL	FELL	
3801	CT56	3801	811734.516	820113.249	紅膠木	Lophostemon confertus	110	4	5	FELL	FELL	FELL	
3801	CT561	3801	811684.815	820110.600	銀合歡	Leucaena leucocephala	232	8	14	FELL	FELL	FELL	
3801	CT562	3801	811682.641	820110.503	椰子	Cocos nucifera	190	4	5	FELL	FELL	FELL	
3801	CT563	3801	811682.432	820118.340	苦楝	Melia azedarach	170	10	14	FELL	FELL	FELL	
3801	CT564	3801	811677.881	820117.771	黃花夾竹桃	Thevetia peruviana	110	3	4	FELL	FELL	FELL	
3801	CT565	3801	811680.359	820119.373	黃花夾竹桃	Thevetia peruviana	232	5	8	FELL	FELL	FELL	
3801	CT566	3801	811681.461	820121.944	台灣相思	Acacia confusa	240	10	14	FELL	FELL	FELL	
3801	CT567	3801	811682.761	820123.636	台灣相思	Acacia confusa	120	7	14	FELL	FELL	FELL	
3801	CT568	3801	811684.787	820123.500	台灣相思	Acacia confusa	170	10	13	FELL	FELL	FELL	
3801	CT569	3801	811684.243	820124.115	台灣相思	Acacia confusa	160	10	15	FELL	FELL	FELL	
3801	CT57	3801	811730.716	820108.620	羊蹄甲屬	Bauhinia spp.	120	4	3	FELL	FELL	FELL	
3801	CT570	3801	811687.861	820123.538	台灣相思	Acacia confusa	150	5	5	FELL	FELL	FELL	
3801	CT571	3801	811686.055	820126.012	台灣相思	Acacia confusa	250	9	11	FELL	FELL	FELL	
3801	CT572	3801	811683.843	820125.468	苦楝	Melia azedarach	240	10	5	FELL	FELL	FELL	
3801	CT573	3801	811680.728	820124.520	大葉相思	Acacia mangium	180	10	10	FELL	FELL	FELL	
3801	CT574	3801	811678.298	820124.801	大葉相思	Acacia mangium	110	3	9	FELL	FELL	FELL	
3801	CT575	3801	811677.517	820124.466	大葉相思	Acacia mangium	270	8	16	FELL	FELL	FELL	
3801	CT576	3801	811677.027	820123.856	大葉相思	Acacia mangium	130	5	9	FELL	FELL	FELL	
3801	CT577	3801	811676.923	820122.893	大葉相思	Acacia mangium	160	5	9	FELL	FELL	FELL	
3801	CT578	3801	811674.008	820125.277	苦楝	Melia azedarach	160	10	10	FELL	FELL	FELL	
3801	CT579	3801	811673.845	820125.904	苦楝	Melia azedarach	250	10	15	FELL	FELL	FELL	
3801	CT58	3801	811729.951	820109.747	台灣相思	Acacia confusa	184	6	8	FELL	FELL	FELL	
3801	CT580	3801	811680.676	820127.920	羊蹄甲屬	Bauhinia spp.	120	4	10	FELL	FELL	FELL	
3801	CT581	3801	811679.211	820130.713	台灣相思	Acacia confusa	140	9	13	FELL	FELL	FELL	
3801	CT582	3801	811680.000	820130.848	台灣相思	Acacia confusa	150	7	12	FELL	FELL	FELL	
3801	CT583	3801	811680.782	820131.188	台灣相思	Acacia confusa	190	6	13	FELL	FELL	FELL	
3801	CT584	3801	811679.250	820131.256	台灣相思	Acacia confusa	130	5	12	FELL	FELL	FELL	
3801	CT585	3801	811679.431	820132.418	台灣相思	Acacia confusa	170	7	14	FELL	FELL	FELL	
3801	CT586	3801	811677.985	820131.842	台灣相思	Acacia confusa	120	5	14	FELL	FELL	FELL	
3801	CT587	3801	811678.203	820131.061	台灣相思	Acacia confusa	120	5	12	FELL	FELL	FELL	
3801	CT588	3801	811677.008	820131.609	台灣相思	Acacia confusa	170	7	14	FELL	FELL	FELL	
3801	CT589	3801	811672.651	820130.192	黃槿	Hibiscus tiliaceus	130	5	7	FELL	FELL	FELL	
3801	CT59	3801	811728.801	820111.344	台灣相思	Acacia confusa	150	3	9	FELL	FELL	FELL	
3801	CT590	3801	811669.397	820132.110	苦楝	Melia azedarach	220	8	11	FELL	FELL	FELL	
3801	CT591	3801	811669.850	820132.892	苦楝	Melia azedarach	130	6	10	FELL	FELL	FELL	
3801	CT592	3801	811670.361	820133.727	苦楝	Melia azedarach	210	9	11	FELL	FELL	FELL	
3801	CT593	3801	811676.391	820135.223	台灣相思	Acacia confusa	262	9	13	FELL	FELL	FELL	
3801	CT594	3801	811667.884	820146.255	苦楝	Melia azedarach	280	10	13	FELL	FELL	FELL	
3801	CT595	3801	811667.767	820147.457	苦楝	Melia azedarach	180	5	11	FELL	FELL	FELL	
3801	CT596	3801	811671.796	820143.142	台灣相思	Acacia confusa	301	12	13	FELL	FELL	FELL	
3801	CT597	3801	811674.187	820142.143	台灣相思	Acacia confusa	262	8	12	FELL	FELL	FELL	
3801	CT598	3801	811677.801	820140.586	台灣相思	Acacia confusa	206	7	11	FELL	FELL	FELL	
3801	CT599	3801	811680.470	820138.077	黃槿	Hibiscus tiliaceus	215	4	11	FELL	FELL	FELL	
3801	CT60	3801	811727.606	820112.655	台灣相思	Acacia confusa	170	5	9	FELL	FELL	FELL	
3801	CT600	3801	811681.389	820140.016	台灣相思	Acacia confusa	180	7	11	FELL	FELL	FELL	
3801	CT601	3801	811683.556	820136.642	台灣相思	Acacia confusa	143	6	10	FELL	FELL	FELL	
3801	CT602	3801	811681.498	820135.152	台灣相思	Acacia confusa	160	5	13	FELL	FELL	FELL	
3801	CT604	3801	811686.934	820134.588	苦楝	Melia azedarach	190	5	9	FELL	FELL	FELL	
3801	CT605	3801	811689.640	820132.743	台灣相思	Acacia confusa	100	4	5	FELL	FELL	FELL	
3801	CT606	3801	811687.072	820133.438	苦楝	Melia azedarach	190	9	10	FELL	FELL	FELL	
3801	CT607	3801	811687.530	820132.713	苦楝	Melia azedarach	220	6	11	FELL	FELL	FELL	
3801	CT608	3801	811685.586	820131.186	台灣相思	Acacia confusa	180	10	14	FELL	FELL	FELL	
3801	CT609	3801	811690.192	820125.902	台灣相思	Acacia confusa	130	5	5	FELL	FELL	FELL	
3801	CT61	3801	811728.869	820112.829	台灣相思	Acacia confusa	120	5	8	FELL	FELL	FELL	
3801	CT610	3801	811692.627	820124.030	台灣相思	Acacia confusa	100	7	5	FELL	FELL	FELL	
3801	CT611	3801	811692.498	820123.154	台灣相思	Acacia confusa	110	7	10	FELL	FELL	FELL	
3801	CT612	3801	811693.533	820122.547	台灣相思	Acacia confusa	130	8	7	FELL	FELL	FELL	
3801	CT613	3801	811694.360	820118.888	羊蹄甲屬	Bauhinia spp.	140	6	6	FELL	FELL	FELL	
3801	CT614	3801	811695.590	820120.299	台灣相思	Acacia confusa	150	5	8	FELL	FELL	FELL	
3801	CT615	3801	811696.364	820119.534	台灣相思	Acacia confusa	190	7	8	FELL	FELL	FELL	
3801	CT616	3801	811697.005	820118.959	台灣相思	Acacia confusa	110	5	4	FELL	FELL	FELL	
3801	CT617	3801	811700.510	820121.409	台灣相思	Acacia confusa	130	6	5	FELL	FELL	FELL	
3801	CT618	3801	811698.305	820123.669	台灣相思	Acacia confusa	100	4	4	FELL	FELL	FELL	
3801	CT619	3801	811699.270	820125.260	台灣相思	Acacia confusa	310	12	9	FELL	FELL	FELL	
3801	CT62	3801	811732.446	820114.914	羊蹄甲屬	Bauhinia spp.	140	5	9	FELL	FELL	FELL	
3801	CT620	3801	811702.449	820118.659	台灣相思	Acacia confusa	130	5	7	FELL	FELL	FELL	
3801	CT621	3801	811703.179	820117.873	台灣相思	Acacia confusa	184	5	7	FELL	FELL	FELL	
3801	CT622	3801	811705.370	820115.206	台灣相思	Acacia confusa	140	6	10	FELL	FELL	FELL	
3801	CT623	3801	811706.322	820112.971	苦楝	Melia azedarach	140	4	7	FELL	FELL	FELL	
3801	CT624	3801	811706.909	820112.250	苦楝	Melia azedarach	220	7	11	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT625	3801	811704.968	820107.885	台灣相思	Acacia confusa	130	5	9	FELL	FELL	FELL	
3801	CT626	3801	811705.261	820107.528	台灣相思	Acacia confusa	120	6	9	FELL	FELL	FELL	
3801	CT627	3801	811710.856	820104.409	台灣相思	Acacia confusa	163	5	4	FELL	FELL	FELL	
3801	CT628	3801	811711.271	820103.560	台灣相思	Acacia confusa	110	5	8	FELL	FELL	FELL	
3801	CT629	3801	811709.677	820108.246	台灣相思	Acacia confusa	170	7	5	FELL	FELL	FELL	
3801	CT63	3801	811733.066	820116.783	羊蹄甲屬	Bauhinia spp.	140	7	7	FELL	FELL	FELL	
3801	CT630	3801	811712.284	820109.161	大葉相思	Acacia mangium	180	6	8	FELL	FELL	FELL	
3801	CT631	3801	811713.042	820107.669	台灣相思	Acacia confusa	110	5	7	FELL	FELL	FELL	
3801	CT632	3801	811715.233	820105.360	台灣相思	Acacia confusa	100	4	8	FELL	FELL	FELL	
3801	CT633	3801	811715.935	820105.649	苦楝	Melia azedarach	150	4	8	FELL	FELL	FELL	
3801	CT634	3801	811715.561	820104.807	台灣相思	Acacia confusa	170	6	9	FELL	FELL	FELL	
3801	CT635	3801	811716.143	820104.036	台灣相思	Acacia confusa	170	7	9	FELL	FELL	FELL	
3801	CT636	3801	811717.532	820104.049	苦楝	Melia azedarach	260	7	10	FELL	FELL	FELL	
3801	CT637	3801	811718.425	820104.110	黃花夾竹桃	Thevetia peruviana	110	4	7	FELL	FELL	FELL	
3801	CT638	3801	811720.435	820101.525	苦楝	Melia azedarach	230	6	8	FELL	FELL	FELL	
3801	CT639	3801	811719.456	820101.346	苦楝	Melia azedarach	160	7	8	FELL	FELL	FELL	
3801	CT64	3801	811732.053	820118.692	羊蹄甲屬	Bauhinia spp.	110	6	5	FELL	FELL	FELL	
3801	CT640	3801	811718.448	820099.422	台灣相思	Acacia confusa	120	4	8	FELL	FELL	FELL	
3801	CT641	3801	811719.755	820097.002	台灣相思	Acacia confusa	120	5	8	FELL	FELL	FELL	
3801	CT642	3801	811717.520	820094.261	台灣相思	Acacia confusa	120	7	10	FELL	FELL	FELL	
3801	CT643	3801	811712.542	820094.387	台灣相思	Acacia confusa	130	5	7	FELL	FELL	FELL	
3801	CT644	3801	811720.338	820089.959	台灣相思	Acacia confusa	170	9	12	FELL	FELL	FELL	
3801	CT645	3801	811722.459	820088.188	死樹	Dead tree	130	8	6	FELL	FELL	FELL	
3801	CT646	3801	811724.402	820088.717	台灣相思	Acacia confusa	198	9	8	FELL	FELL	FELL	
3801	CT647	3801	811724.451	820088.218	台灣相思	Acacia confusa	170	7	13	FELL	FELL	FELL	
3801	CT648	3801	811725.148	820084.660	台灣相思	Acacia confusa	240	8	13	FELL	FELL	FELL	
3801	CT649	3801	811726.185	820086.232	台灣相思	Acacia confusa	160	8	13	FELL	FELL	FELL	
3801	CT65	3801	811732.419	820119.146	羊蹄甲屬	Bauhinia spp.	120	5	7	FELL	FELL	FELL	
3801	CT650	3801	811725.889	820087.217	台灣相思	Acacia confusa	110	5	12	FELL	FELL	FELL	
3801	CT651	3801	811726.146	820088.611	台灣相思	Acacia confusa	120	8	10	FELL	FELL	FELL	
3801	CT652	3801	811727.545	820089.135	苦楝	Melia azedarach	250	7	10	FELL	FELL	FELL	
3801	CT653	3801	811723.448	820096.911	羊蹄甲屬	Bauhinia spp.	100	4	5	FELL	FELL	FELL	
3801	CT654	3801	811724.632	820095.491	羊蹄甲屬	Bauhinia spp.	120	5	6	FELL	FELL	FELL	
3801	CT655	3801	811722.894	820094.498	紅膠木	Lophostemon confertus	110	5	7	FELL	FELL	FELL	
3801	CT656	3801	811726.570	820086.829	台灣相思	Acacia confusa	160	7	13	FELL	FELL	FELL	
3801	CT657	3801	811729.221	820086.093	大葉相思	Acacia mangium	180	5	9	FELL	FELL	FELL	
3801	CT658	3801	811728.346	820084.776	台灣相思	Acacia confusa	140	6	13	FELL	FELL	FELL	
3801	CT659	3801	811727.822	820083.859	台灣相思	Acacia confusa	150	7	12	FELL	FELL	FELL	
3801	CT66	3801	811731.262	820119.343	羊蹄甲屬	Bauhinia spp.	150	5	8	FELL	FELL	FELL	
3801	CT660	3801	811729.841	820082.662	台灣相思	Acacia confusa	188	8	14	FELL	FELL	FELL	
3801	CT661	3801	811730.342	820081.042	台灣相思	Acacia confusa	140	6	12	FELL	FELL	FELL	
3801	CT662	3801	811732.060	820081.652	台灣相思	Acacia confusa	150	5	10	FELL	FELL	FELL	
3801	CT663	3801	811732.872	820080.443	台灣相思	Acacia confusa	130	5	8	FELL	FELL	FELL	
3801	CT664	3801	811732.623	820079.190	台灣相思	Acacia confusa	100	4	8	FELL	FELL	FELL	
3801	CT665	3801	811734.208	820078.169	台灣相思	Acacia confusa	110	5	8	FELL	FELL	FELL	
3801	CT666	3801	811737.094	820072.622	台灣相思	Acacia confusa	130	6	8	FELL	FELL	FELL	
3801	CT667	3801	811738.314	820070.083	台灣相思	Acacia confusa	140	5	8	FELL	FELL	FELL	
3801	CT668	3801	811736.370	820069.716	台灣相思	Acacia confusa	110	5	7	FELL	FELL	FELL	
3801	CT669	3801	811735.492	820070.903	羊蹄甲屬	Bauhinia spp.	100	4	6	FELL	FELL	FELL	
3801	CT67	3801	811730.398	820120.243	台灣相思	Acacia confusa	180	7	10	FELL	FELL	FELL	
3801	CT670	3801	811735.915	820071.012	台灣相思	Acacia confusa	160	6	7	FELL	FELL	FELL	
3801	CT671	3801	811735.009	820072.239	台灣相思	Acacia confusa	262	7	9	FELL	FELL	FELL	
3801	CT672	3801	811668.547	820088.977	大葉相思	Acacia mangium	340	9	10	FELL	FELL	FELL	
3801	CT673	3801	811666.354	820113.763	羊蹄甲屬	Bauhinia spp.	110	5	9	FELL	FELL	FELL	
3801	CT674	3801	811664.554	820113.198	羊蹄甲屬	Bauhinia spp.	140	5	10	FELL	FELL	FELL	
3801	CT675	3801	811660.285	820113.025	大葉相思	Acacia mangium	210	5	12	FELL	FELL	FELL	
3801	CT676	3801	811658.432	820113.350	台灣相思	Acacia confusa	200	6	11	FELL	FELL	FELL	
3801	CT677	3801	811658.418	820114.567	台灣相思	Acacia confusa	180	6	11	FELL	FELL	FELL	
3801	CT678	3801	811657.237	820114.638	台灣相思	Acacia confusa	120	5	9	FELL	FELL	FELL	
3801	CT679	3801	811656.321	820114.775	台灣相思	Acacia confusa	140	7	9	FELL	FELL	FELL	
3801	CT68	3801	811731.110	820120.534	台灣相思	Acacia confusa	160	7	8	FELL	FELL	FELL	
3801	CT680	3801	811657.034	820115.678	台灣相思	Acacia confusa	100	5	9	FELL	FELL	FELL	
3801	CT681	3801	811658.085	820115.423	台灣相思	Acacia confusa	140	4	10	FELL	FELL	FELL	
3801	CT682	3801	811658.810	820116.191	台灣相思	Acacia confusa	140	6	8	FELL	FELL	FELL	
3801	CT683	3801	811659.954	820116.000	台灣相思	Acacia confusa	160	6	8	FELL	FELL	FELL	
3801	CT684	3801	811660.536	820115.803	台灣相思	Acacia confusa	190	7	9	FELL	FELL	FELL	
3801	CT685	3801	811656.720	820116.574	台灣相思	Acacia confusa	230	6	10	FELL	FELL	FELL	
3801	CT686	3801	811657.067	820117.386	苦楝	Melia azedarach	220	5	11	FELL	FELL	FELL	
3801	CT688	3801	811656.994	820125.820	潺槁樹	Litsea glutinosa	100	4	6	FELL	FELL	FELL	
3801	CT689	3801	811655.204	820121.931	台灣相思	Acacia confusa	110	7	8	FELL	FELL	FELL	
3801	CT69	3801	811729.891	820120.859	台灣相思	Acacia confusa	170	7	8	FELL	FELL	FELL	
3801	CT690	3801	811654.325	820122.711	台灣相思	Acacia confusa	260	9	10	FELL	FELL	FELL	
3801	CT691	3801	811654.274	820122.080	台灣相思	Acacia confusa	180	7	8	FELL	FELL	FELL	
3801	CT692	3801	811652.982	820123.153	台灣相思	Acacia confusa	130	7	9	FELL	FELL	FELL	
3801	CT693	3801	811653.371	820124.291	台灣相思	Acacia confusa	130	5	8	FELL	FELL	FELL	
3801	CT694	3801	811652.325	820124.395	台灣相思	Acacia confusa	150	7	9	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT695	3801	811652.403	820125.156	台灣相思	Acacia confusa	130	4	10	FELL	FELL	FELL	
3801	CT696	3801	811651.370	820125.110	台灣相思	Acacia confusa	120	6	8	FELL	FELL	FELL	
3801	CT697	3801	811650.970	820126.683	羊蹄甲屬	Bauhinia spp.	120	4	5	FELL	FELL	FELL	
3801	CT698	3801	811652.013	820130.329	紅膠木	Lophostemon confertus	160	4	10	FELL	FELL	FELL	
3801	CT699	3801	811650.005	820131.666	台灣相思	Acacia confusa	190	7	8	FELL	FELL	FELL	
3801	CT70	3801	811728.118	820123.298	台灣相思	Acacia confusa	150	5	9	FELL	FELL	FELL	
3801	CT700	3801	811649.234	820132.527	台灣相思	Acacia confusa	180	7	10	FELL	FELL	FELL	
3801	CT701	3801	811648.433	820131.499	台灣相思	Acacia confusa	200	6	12	FELL	FELL	FELL	
3801	CT702	3801	811648.636	820132.490	台灣相思	Acacia confusa	110	4	8	FELL	FELL	FELL	
3801	CT703	3801	811647.245	820133.698	大葉相思	Acacia mangium	140	4	10	FELL	FELL	FELL	
3801	CT704	3801	811646.308	820133.284	苦楝	Melia azedarach	120	4	12	FELL	FELL	FELL	
3801	CT705	3801	811646.328	820134.522	苦楝	Melia azedarach	110	4	9	FELL	FELL	FELL	
3801	CT706	3801	811647.221	820134.985	苦楝	Melia azedarach	120	4	9	FELL	FELL	FELL	
3801	CT707	3801	811648.229	820135.608	苦楝	Melia azedarach	120	2	6	FELL	FELL	FELL	
3801	CT708	3801	811645.684	820135.196	苦楝	Melia azedarach	130	5	8	FELL	FELL	FELL	
3801	CT709	3801	811644.058	820137.438	耳果相思	Acacia auriculiformis	100	4	8	FELL	FELL	FELL	
3801	CT71	3801	811727.211	820124.000	台灣相思	Acacia confusa	160	6	7	FELL	FELL	FELL	
3801	CT710	3801	811641.396	820134.938	台灣相思	Acacia confusa	150	8	9	FELL	FELL	FELL	
3801	CT711	3801	811640.400	820134.843	台灣相思	Acacia confusa	100	4	10	FELL	FELL	FELL	
3801	CT712	3801	811640.380	820135.848	台灣相思	Acacia confusa	110	5	10	FELL	FELL	FELL	
3801	CT713	3801	811638.711	820136.869	台灣相思	Acacia confusa	191	8	10	FELL	FELL	FELL	
3801	CT714	3801	811637.918	820137.258	台灣相思	Acacia confusa	163	5	12	FELL	FELL	FELL	
3801	CT715	3801	811638.709	820136.154	台灣相思	Acacia confusa	130	5	9	FELL	FELL	FELL	
3801	CT716	3801	811639.280	820131.614	羊蹄甲屬	Bauhinia spp.	110	7	9	FELL	FELL	FELL	
3801	CT717	3801	811640.823	820129.758	苦楝	Melia azedarach	270	7	13	FELL	FELL	FELL	
3801	CT718	3801	811641.624	820129.984	羊蹄甲屬	Bauhinia spp.	120	6	8	FELL	FELL	FELL	
3801	CT719	3801	811641.649	820127.805	台灣相思	Acacia confusa	110	5	9	FELL	FELL	FELL	
3801	CT72	3801	811726.432	820124.609	大葉相思	Acacia mangium	270	6	12	FELL	FELL	FELL	
3801	CT720	3801	811641.983	820126.995	台灣相思	Acacia confusa	200	7	10	FELL	FELL	FELL	
3801	CT721	3801	811648.793	820121.870	台灣相思	Acacia confusa	160	9	12	FELL	FELL	FELL	
3801	CT722	3801	811647.629	820121.355	台灣相思	Acacia confusa	100	4	11	FELL	FELL	FELL	
3801	CT723	3801	811647.298	820120.607	台灣相思	Acacia confusa	140	5	13	FELL	FELL	FELL	
3801	CT724	3801	811649.231	820119.858	台灣相思	Acacia confusa	110	5	12	FELL	FELL	FELL	
3801	CT725	3801	811647.785	820119.434	台灣相思	Acacia confusa	100	5	10	FELL	FELL	FELL	
3801	CT726	3801	811646.231	820119.473	台灣相思	Acacia confusa	200	6	11	FELL	FELL	FELL	
3801	CT727	3801	811645.723	820121.032	台灣相思	Acacia confusa	150	7	10	FELL	FELL	FELL	
3801	CT728	3801	811642.169	820122.250	羊蹄甲屬	Bauhinia spp.	110	6	9	FELL	FELL	FELL	
3801	CT729	3801	811642.032	820125.191	台灣相思	Acacia confusa	170	8	10	FELL	FELL	FELL	
3801	CT73	3801	811726.139	820120.074	台灣相思	Acacia confusa	170	10	9	FELL	FELL	FELL	
3801	CT730	3801	811641.077	820125.497	台灣相思	Acacia confusa	170	9	11	FELL	FELL	FELL	
3801	CT731	3801	811638.493	820125.537	台灣相思	Acacia confusa	150	7	12	FELL	FELL	FELL	
3801	CT732	3801	811637.737	820125.192	羊蹄甲屬	Bauhinia spp.	120	4	8	FELL	FELL	FELL	
3801	CT733	3801	811637.863	820126.066	台灣相思	Acacia confusa	140	6	8	FELL	FELL	FELL	
3801	CT734	3801	811636.771	820125.851	台灣相思	Acacia confusa	170	5	11	FELL	FELL	FELL	
3801	CT735	3801	811637.912	820128.845	台灣相思	Acacia confusa	150	7	12	FELL	FELL	FELL	
3801	CT736	3801	811638.656	820129.217	台灣相思	Acacia confusa	100	3	12	FELL	FELL	FELL	
3801	CT737	3801	811637.191	820130.323	台灣相思	Acacia confusa	110	3	11	FELL	FELL	FELL	
3801	CT738	3801	811636.316	820129.878	台灣相思	Acacia confusa	110	2	11	FELL	FELL	FELL	
3801	CT739	3801	811635.090	820131.588	台灣相思	Acacia confusa	170	6	12	FELL	FELL	FELL	
3801	CT74	3801	811725.411	820120.985	台灣相思	Acacia confusa	150	6	10	FELL	FELL	FELL	
3801	CT740	3801	811635.596	820133.466	苦楝	Melia azedarach	170	1	11	FELL	FELL	FELL	
3801	CT741	3801	811634.112	820132.415	台灣相思	Acacia confusa	170	5	15	FELL	FELL	FELL	
3801	CT742	3801	811633.419	820132.746	台灣相思	Acacia confusa	110	4	9	FELL	FELL	FELL	
3801	CT743	3801	811631.555	820131.863	大葉相思	Acacia mangium	160	4	13	FELL	FELL	FELL	
3801	CT744	3801	811631.484	820130.848	大葉相思	Acacia mangium	170	3	15	FELL	FELL	FELL	
3801	CT745	3801	811630.960	820132.217	大葉相思	Acacia mangium	130	4	15	FELL	FELL	FELL	
3801	CT746	3801	811627.839	820131.068	苦楝	Melia azedarach	270	9	15	FELL	FELL	FELL	
3801	CT747	3801	811627.941	820133.460	大葉相思	Acacia mangium	150	3	14	FELL	FELL	FELL	
3801	CT748	3801	811624.973	820132.750	大葉相思	Acacia mangium	240	5	14	FELL	FELL	FELL	
3801	CT749	3801	811624.892	820133.709	大葉相思	Acacia mangium	160	4	13	FELL	FELL	FELL	
3801	CT75	3801	811723.776	820122.316	台灣相思	Acacia confusa	110	5	10	FELL	FELL	FELL	
3801	CT750	3801	811625.911	820134.671	台灣相思	Acacia confusa	100	5	10	FELL	FELL	FELL	
3801	CT751	3801	811624.927	820135.487	台灣相思	Acacia confusa	160	5	12	FELL	FELL	FELL	
3801	CT752	3801	811623.359	820136.054	台灣相思	Acacia confusa	160	8	12	FELL	FELL	FELL	
3801	CT753	3801	811619.166	820136.604	台灣相思	Acacia confusa	140	6	11	FELL	FELL	FELL	
3801	CT754	3801	811619.192	820135.553	台灣相思	Acacia confusa	170	7	11	FELL	FELL	FELL	
3801	CT755	3801	811620.308	820133.625	大葉相思	Acacia mangium	190	6	9	FELL	FELL	FELL	
3801	CT756	3801	811617.352	820134.181	台灣相思	Acacia confusa	130	6	6	FELL	FELL	FELL	
3801	CT757	3801	811616.209	820134.397	台灣相思	Acacia confusa	170	5	13	FELL	FELL	FELL	
3801	CT758	3801	811615.358	820134.516	台灣相思	Acacia confusa	150	6	9	FELL	FELL	FELL	
3801	CT759	3801	811615.360	820135.360	台灣相思	Acacia confusa	150	7	10	FELL	FELL	FELL	
3801	CT76	3801	811721.819	820124.078	苦楝	Melia azedarach	220	10	11	FELL	FELL	FELL	
3801	CT760	3801	811616.474	820137.221	台灣相思	Acacia confusa	130	5	11	FELL	FELL	FELL	
3801	CT761	3801	811615.978	820138.200	台灣相思	Acacia confusa	160	5	12	FELL	FELL	FELL	
3801	CT762	3801	811615.183	820137.415	台灣相思	Acacia confusa	130	7	8	FELL	FELL	FELL	
3801	CT763	3801	811614.280	820138.663	台灣相思	Acacia confusa	190	8	10	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT764	3801	811612.488	820136.608	台灣相思	Acacia confusa	150	7	11	FELL	FELL	FELL	
3801	CT765	3801	811611.804	820128.114	銀合歡	Leucaena leucocephala	140	8	14	FELL	FELL	FELL	
3801	CT766	3801	811605.438	820134.692	銀合歡	Leucaena leucocephala	100	10	9	FELL	FELL	FELL	
3801	CT767	3801	811600.977	820136.418	銀合歡	Leucaena leucocephala	214	11	11	FELL	FELL	FELL	
3801	CT768	3801	811607.029	820137.200	台灣相思	Acacia confusa	170	6	11	FELL	FELL	FELL	
3801	CT769	3801	811601.200	820138.216	羊蹄甲屬	Bauhinia spp.	160	7	9	FELL	FELL	FELL	
3801	CT77	3801	811725.729	820127.252	大葉相思	Acacia mangium	120	4	7	FELL	FELL	FELL	
3801	CT770	3801	811600.374	820138.421	台灣相思	Acacia confusa	170	8	11	FELL	FELL	FELL	
3801	CT771	3801	811599.144	820138.377	台灣相思	Acacia confusa	210	8	9	FELL	FELL	FELL	
3801	CT772	3801	811597.809	820139.198	台灣相思	Acacia confusa	110	3	12	FELL	FELL	FELL	
3801	CT773	3801	811597.260	820138.444	台灣相思	Acacia confusa	140	10	9	FELL	FELL	FELL	
3801	CT774	3801	811597.287	820139.165	台灣相思	Acacia confusa	160	4	8	FELL	FELL	FELL	
3801	CT775	3801	811595.962	820139.020	台灣相思	Acacia confusa	120	3	7	FELL	FELL	FELL	
3801	CT776	3801	811593.928	820138.370	銀合歡	Leucaena leucocephala	100	4	12	FELL	FELL	FELL	
3801	CT777	3801	811594.215	820138.075	台灣相思	Acacia confusa	130	7	7	FELL	FELL	FELL	
3801	CT778	3801	811593.166	820139.137	台灣相思	Acacia confusa	130	4	6	FELL	FELL	FELL	
3801	CT779	3801	811591.717	820133.980	羊蹄甲屬	Bauhinia spp.	140	2	8	FELL	FELL	FELL	
3801	CT78	3801	811724.421	820128.780	大葉相思	Acacia mangium	180	5	10	FELL	FELL	FELL	
3801	CT780	3801	811589.094	820133.741	台灣相思	Acacia confusa	100	6	6	FELL	FELL	FELL	
3801	CT781	3801	811588.415	820134.141	台灣相思	Acacia confusa	110	7	10	FELL	FELL	FELL	
3801	CT782	3801	811588.561	820134.753	台灣相思	Acacia confusa	130	4	9	FELL	FELL	FELL	
3801	CT783	3801	811588.879	820136.717	銀合歡	Leucaena leucocephala	100	4	12	FELL	FELL	FELL	
3801	CT784	3801	811586.948	820136.122	台灣相思	Acacia confusa	120	5	10	FELL	FELL	FELL	
3801	CT785	3801	811587.466	820133.550	台灣相思	Acacia confusa	120	7	9	FELL	FELL	FELL	
3801	CT786	3801	811585.906	820133.493	台灣相思	Acacia confusa	120	5	12	FELL	FELL	FELL	
3801	CT787	3801	811584.819	820133.217	台灣相思	Acacia confusa	100	6	9	FELL	FELL	FELL	
3801	CT788	3801	811583.845	820133.243	台灣相思	Acacia confusa	120	4	12	FELL	FELL	FELL	
3801	CT789	3801	811582.540	820133.145	台灣相思	Acacia confusa	130	5	13	FELL	FELL	FELL	
3801	CT79	3801	811724.688	820129.666	大葉相思	Acacia mangium	210	5	8	FELL	FELL	FELL	
3801	CT790	3801	811581.815	820133.942	苦楝	Melia azedarach	130	5	13	FELL	FELL	FELL	
3801	CT791	3801	811581.298	820133.189	台灣相思	Acacia confusa	120	4	13	FELL	FELL	FELL	
3801	CT792	3801	811578.941	820135.776	羊蹄甲屬	Bauhinia spp.	100	3	10	FELL	FELL	FELL	
3801	CT793	3801	811578.058	820130.990	銀合歡	Leucaena leucocephala	100	5	13	FELL	FELL	FELL	
3801	CT794	3801	811576.009	820133.651	銀合歡	Leucaena leucocephala	111	3	13	FELL	FELL	FELL	
3801	CT795	3801	811575.216	820134.153	銀合歡	Leucaena leucocephala	140	7	13	FELL	FELL	FELL	
3801	CT796	3801	811577.485	820135.113	銀合歡	Leucaena leucocephala	120	8	7	FELL	FELL	FELL	
3801	CT797	3801	811576.206	820134.814	銀合歡	Leucaena leucocephala	120	9	9	FELL	FELL	FELL	
3801	CT798	3801	811571.463	820135.500	銀合歡	Leucaena leucocephala	100	5	9	FELL	FELL	FELL	
3801	CT799	3801	811570.756	820128.819	銀合歡	Leucaena leucocephala	110	3	13	FELL	FELL	FELL	
3801	CT80	3801	811724.289	820130.573	大葉相思	Acacia mangium	110	3	5	FELL	FELL	FELL	
3801	CT800	3801	811567.750	820130.213	銀合歡	Leucaena leucocephala	110	10	7	FELL	FELL	FELL	
3801	CT801	3801	811562.869	820130.496	銀合歡	Leucaena leucocephala	110	5	9	FELL	FELL	FELL	
3801	CT802	3801	811561.617	820130.104	銀合歡	Leucaena leucocephala	190	6	13	FELL	FELL	FELL	
3801	CT803	3801	811557.283	820130.588	銀合歡	Leucaena leucocephala	120	3	10	FELL	FELL	FELL	
3801	CT804	3801	811554.902	820133.605	銀合歡	Leucaena leucocephala	240	8	14	FELL	FELL	FELL	
3801	CT805	3801	811555.149	820137.178	銀合歡	Leucaena leucocephala	130	5	11	FELL	FELL	FELL	
3801	CT806	3801	811559.949	820139.787	銀合歡	Leucaena leucocephala	100	7	9	FELL	FELL	FELL	
3801	CT807	3801	811566.206	820137.497	銀合歡	Leucaena leucocephala	120	9	9	FELL	FELL	FELL	
3801	CT808	3801	811550.692	820140.926	銀合歡	Leucaena leucocephala	230	13	15	FELL	FELL	FELL	
3801	CT809	3801	811546.582	820140.800	銀合歡	Leucaena leucocephala	160	5	14	FELL	FELL	FELL	
3801	CT81	3801	811722.544	820132.500	大葉相思	Acacia mangium	210	5	10	FELL	FELL	FELL	
3801	CT810	3801	811546.590	820144.611	銀合歡	Leucaena leucocephala	100	2	9	FELL	FELL	FELL	
3801	CT811	3801	811544.960	820145.644	羊蹄甲屬	Bauhinia spp.	110	4	6	FELL	FELL	FELL	
3801	CT812	3801	811551.197	820149.059	銀合歡	Leucaena leucocephala	120	4	13	FELL	FELL	FELL	
3801	CT813	3801	811562.402	820145.653	銀合歡	Leucaena leucocephala	240	12	14	FELL	FELL	FELL	
3801	CT814	3801	811561.741	820144.121	銀合歡	Leucaena leucocephala	130	10	9	FELL	FELL	FELL	
3801	CT815	3801	811562.284	820142.342	黃花夾竹桃	Thevetia peruviana	110	4	8	FELL	FELL	FELL	
3801	CT816	3801	811564.294	820147.487	台灣相思	Acacia confusa	170	9	11	FELL	FELL	FELL	
3801	CT817	3801	811563.617	820147.668	台灣相思	Acacia confusa	160	8	12	FELL	FELL	FELL	
3801	CT818	3801	811564.151	820148.929	台灣相思	Acacia confusa	150	5	10	FELL	FELL	FELL	
3801	CT819	3801	811564.361	820149.574	台灣相思	Acacia confusa	170	6	10	FELL	FELL	FELL	
3801	CT82	3801	811721.594	820131.589	台灣相思	Acacia confusa	250	8	12	FELL	FELL	FELL	
3801	CT820	3801	811565.021	820150.461	苦楝	Melia azedarach	100	5	9	FELL	FELL	FELL	
3801	CT821	3801	811569.155	820152.269	羊蹄甲屬	Bauhinia spp.	350	6	8	FELL	FELL	FELL	
3801	CT822	3801	811573.060	820153.799	台灣相思	Acacia confusa	100	3	5	FELL	FELL	FELL	
3801	CT823	3801	811571.472	820151.374	羊蹄甲屬	Bauhinia spp.	110	4	9	FELL	FELL	FELL	
3801	CT824	3801	811574.713	820148.659	黃花夾竹桃	Thevetia peruviana	100	3	5	FELL	FELL	FELL	
3801	CT825	3801	811576.045	820146.801	大葉相思	Acacia mangium	170	4	9	FELL	FELL	FELL	
3801	CT826	3801	811572.201	820145.635	大葉相思	Acacia mangium	130	3	13	FELL	FELL	FELL	
3801	CT827	3801	811569.832	820145.748	大葉相思	Acacia mangium	240	5	15	FELL	FELL	FELL	
3801	CT828	3801	811567.519	820144.873	銀合歡	Leucaena leucocephala	160	11	13	FELL	FELL	FELL	
3801	CT829	3801	811565.683	820143.266	台灣相思	Acacia confusa	130	5	10	FELL	FELL	FELL	
3801	CT83	3801	811719.933	820136.186	銀合歡	Leucaena leucocephala	120	7	8	FELL	FELL	FELL	
3801	CT830	3801	811567.407	820142.123	台灣相思	Acacia confusa	262	8	14	FELL	FELL	FELL	
3801	CT831	3801	811568.429	820142.307	台灣相思	Acacia confusa	100	3	8	FELL	FELL	FELL	
3801	CT832	3801	811568.567	820140.845	台灣相思	Acacia confusa	200	5	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT833	3801	811565.694	820138.207	銀合歡	Leucaena leucocephala	110	9	9	FELL	FELL	FELL	
3801	CT834	3801	811566.979	820136.897	銀合歡	Leucaena leucocephala	130	9	8	FELL	FELL	FELL	
3801	CT835	3801	811569.853	820137.673	銀合歡	Leucaena leucocephala	100	6	10	FELL	FELL	FELL	
3801	CT836	3801	811570.161	820142.657	銀合歡	Leucaena leucocephala	130	6	13	FELL	FELL	FELL	
3801	CT837	3801	811572.243	820144.089	銀合歡	Leucaena leucocephala	210	6	15	FELL	FELL	FELL	
3801	CT838	3801	811574.635	820140.154	銀合歡	Leucaena leucocephala	130	5	15	FELL	FELL	FELL	
3801	CT839	3801	811576.650	820137.984	銀合歡	Leucaena leucocephala	130	3	7	FELL	FELL	FELL	
3801	CT84	3801	811719.219	820136.163	大葉相思	Acacia mangium	320	6	8	FELL	FELL	FELL	
3801	CT840	3801	811577.628	820138.723	銀合歡	Leucaena leucocephala	190	3	9	FELL	FELL	FELL	
3801	CT841	3801	811578.316	820142.223	銀合歡	Leucaena leucocephala	150	4	13	FELL	FELL	FELL	
3801	CT842	3801	811579.737	820141.507	銀合歡	Leucaena leucocephala	140	4	11	FELL	FELL	FELL	
3801	CT843	3801	811580.667	820139.394	羊蹄甲屬	Bauhinia spp.	130	6	9	FELL	FELL	FELL	
3801	CT844	3801	811581.310	820138.926	羊蹄甲屬	Bauhinia spp.	120	4	10	FELL	FELL	FELL	
3801	CT845	3801	811584.404	820138.480	苦楝	Melia azedarach	160	4	11	FELL	FELL	FELL	
3801	CT846	3801	811585.268	820137.673	台灣相思	Acacia confusa	150	6	11	FELL	FELL	FELL	
3801	CT847	3801	811586.029	820137.552	台灣相思	Acacia confusa	200	5	11	FELL	FELL	FELL	
3801	CT848	3801	811587.422	820139.790	大葉相思	Acacia mangium	180	5	12	FELL	FELL	FELL	
3801	CT849	3801	811589.924	820140.332	大葉相思	Acacia mangium	170	5	14	FELL	FELL	FELL	
3801	CT85	3801	811718.831	820137.027	大葉相思	Acacia mangium	200	5	11	FELL	FELL	FELL	
3801	CT850	3801	811591.556	820144.270	死樹	Dead tree	110	3	7	FELL	FELL	FELL	
3801	CT851	3801	811589.685	820144.051	大葉相思	Acacia mangium	110	4	8	FELL	FELL	FELL	
3801	CT852	3801	811588.829	820144.002	大葉相思	Acacia mangium	120	4	9	FELL	FELL	FELL	
3801	CT853	3801	811587.225	820143.919	羊蹄甲屬	Bauhinia spp.	100	5	8	FELL	FELL	FELL	
3801	CT854	3801	811585.540	820145.185	羊蹄甲屬	Bauhinia spp.	120	5	9	FELL	FELL	FELL	
3801	CT855	3801	811584.517	820145.257	台灣相思	Acacia confusa	130	4	9	FELL	FELL	FELL	
3801	CT857	3801	811580.058	820144.562	苦楝	Melia azedarach	240	6	15	FELL	FELL	FELL	
3801	CT858	3801	811580.584	820145.353	大葉相思	Acacia mangium	150	4	10	FELL	FELL	FELL	
3801	CT859	3801	811574.848	820144.564	紅膠木	Lophostemon confertus	190	4	12	FELL	FELL	FELL	
3801	CT86	3801	811718.356	820137.511	大葉相思	Acacia mangium	100	1	7	FELL	FELL	FELL	
3801	CT860	3801	811577.483	820146.380	大葉相思	Acacia mangium	160	4	10	FELL	FELL	FELL	
3801	CT861	3801	811580.149	820149.877	苦楝	Melia azedarach	140	8	9	FELL	FELL	FELL	
3801	CT862	3801	811581.324	820150.528	苦楝	Melia azedarach	160	5	11	FELL	FELL	FELL	
3801	CT863	3801	811584.560	820148.364	黃花夾竹桃	Thevetia peruviana	227	6	5	FELL	FELL	FELL	
3801	CT864	3801	811585.547	820145.824	台灣相思	Acacia confusa	260	10	15	FELL	FELL	FELL	
3801	CT865	3801	811587.979	820145.608	台灣相思	Acacia confusa	120	4	11	FELL	FELL	FELL	
3801	CT866	3801	811588.179	820146.363	台灣相思	Acacia confusa	100	4	8	FELL	FELL	FELL	
3801	CT867	3801	811588.976	820145.743	台灣相思	Acacia confusa	150	5	10	FELL	FELL	FELL	
3801	CT868	3801	811589.724	820145.959	台灣相思	Acacia confusa	130	9	11	FELL	FELL	FELL	
3801	CT869	3801	811591.414	820146.139	台灣相思	Acacia confusa	170	8	12	FELL	FELL	FELL	
3801	CT87	3801	811717.268	820134.654	台灣相思	Acacia confusa	140	7	11	FELL	FELL	FELL	
3801	CT870	3801	811594.954	820145.213	台灣相思	Acacia confusa	130	3	6	FELL	FELL	FELL	
3801	CT871	3801	811598.786	820143.495	台灣相思	Acacia confusa	156	5	8	FELL	FELL	FELL	
3801	CT872	3801	811601.688	820142.760	大葉相思	Acacia mangium	110	4	9	FELL	FELL	FELL	
3801	CT873	3801	811595.781	820140.705	銀合歡	Leucaena leucocephala	120	4	11	FELL	FELL	FELL	
3801	CT874	3801	811605.070	820141.771	大葉相思	Acacia mangium	310	8	14	FELL	FELL	FELL	
3801	CT875	3801	811607.701	820143.001	台灣相思	Acacia confusa	130	8	10	FELL	FELL	FELL	
3801	CT876	3801	811606.565	820144.331	台灣相思	Acacia confusa	100	7	7	FELL	FELL	FELL	
3801	CT877	3801	811607.277	820144.851	台灣相思	Acacia confusa	150	6	11	FELL	FELL	FELL	
3801	CT878	3801	811608.072	820146.824	苦楝	Melia azedarach	160	4	12	FELL	FELL	FELL	
3801	CT879	3801	811609.273	820144.867	台灣相思	Acacia confusa	180	5	11	FELL	FELL	FELL	
3801	CT88	3801	811716.411	820138.704	大葉相思	Acacia mangium	110	6	5	FELL	FELL	FELL	
3801	CT880	3801	811609.509	820143.208	台灣相思	Acacia confusa	160	4	12	FELL	FELL	FELL	
3801	CT881	3801	811615.677	820142.284	大葉相思	Acacia mangium	180	5	12	FELL	FELL	FELL	
3801	CT882	3801	811617.651	820141.156	死樹	Dead tree	340	8	10	FELL	FELL	FELL	
3801	CT883	3801	811623.063	820139.727	台灣相思	Acacia confusa	100	5	12	FELL	FELL	FELL	
3801	CT884	3801	811623.527	820141.084	大葉相思	Acacia mangium	200	5	15	FELL	FELL	FELL	
3801	CT885	3801	811628.092	820137.432	台灣相思	Acacia confusa	130	5	13	FELL	FELL	FELL	
3801	CT886	3801	811628.826	820137.058	台灣相思	Acacia confusa	130	6	13	FELL	FELL	FELL	
3801	CT887	3801	811631.684	820141.243	羊蹄甲屬	Bauhinia spp.	110	5	5	FELL	FELL	FELL	
3801	CT888	3801	811634.432	820142.740	台灣相思	Acacia confusa	160	6	9	FELL	FELL	FELL	
3801	CT889	3801	811635.834	820143.492	台灣相思	Acacia confusa	120	4	7	FELL	FELL	FELL	
3801	CT89	3801	811715.371	820140.085	大葉相思	Acacia mangium	190	5	12	FELL	FELL	FELL	
3801	CT890	3801	811634.916	820143.892	台灣相思	Acacia confusa	140	6	7	FELL	FELL	FELL	
3801	CT891	3801	811634.225	820144.356	台灣相思	Acacia confusa	160	5	8	FELL	FELL	FELL	
3801	CT892	3801	811633.245	820144.855	台灣相思	Acacia confusa	110	3	8	FELL	FELL	FELL	
3801	CT893	3801	811633.575	820143.683	台灣相思	Acacia confusa	120	4	9	FELL	FELL	FELL	
3801	CT894	3801	811629.873	820143.990	大葉相思	Acacia mangium	140	4	9	FELL	FELL	FELL	
3801	CT895	3801	811629.602	820141.735	苦楝	Melia azedarach	230	7	10	FELL	FELL	FELL	
3801	CT896	3801	811626.640	820143.059	台灣相思	Acacia confusa	160	7	10	FELL	FELL	FELL	
3801	CT897	3801	811625.725	820143.760	台灣相思	Acacia confusa	140	6	9	FELL	FELL	FELL	
3801	CT898	3801	811624.816	820143.764	台灣相思	Acacia confusa	130	5	12	FELL	FELL	FELL	
3801	CT899	3801	811622.496	820144.157	台灣相思	Acacia confusa	120	4	11	FELL	FELL	FELL	
3801	CT90	3801	811715.871	820141.038	銀合歡	Leucaena leucocephala	156	7	9	FELL	FELL	FELL	
3801	CT900	3801	811621.995	820144.111	台灣相思	Acacia confusa	130	6	11	FELL	FELL	FELL	
3801	CT901	3801	811623.874	820148.391	羊蹄甲屬	Bauhinia spp.	190	5	7	FELL	FELL	FELL	
3801	CT902	3801	811616.806	820148.572	台灣相思	Acacia confusa	180	5	8	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT903	3801	811615.634	820146.515	台灣相思	Acacia confusa	150	4	8	FELL	FELL	FELL	
3801	CT904	3801	811616.003	820146.226	台灣相思	Acacia confusa	120	3	7	FELL	FELL	FELL	
3801	CT905	3801	811617.460	820144.787	台灣相思	Acacia confusa	110	4	8	FELL	FELL	FELL	
3801	CT906	3801	811615.943	820145.358	台灣相思	Acacia confusa	110	3	8	FELL	FELL	FELL	
3801	CT907	3801	811614.500	820145.765	台灣相思	Acacia confusa	150	5	8	FELL	FELL	FELL	
3801	CT908	3801	811613.465	820148.156	台灣相思	Acacia confusa	231	5	8	FELL	FELL	FELL	
3801	CT909	3801	811605.529	820149.520	台灣相思	Acacia confusa	170	4	7	FELL	FELL	FELL	
3801	CT91	3801	811714.961	820141.592	苦楝	Melia azedarach	120	4	11	FELL	FELL	FELL	
3801	CT910	3801	811604.252	820149.564	台灣相思	Acacia confusa	140	5	8	FELL	FELL	FELL	
3801	CT911	3801	811603.428	820150.140	台灣相思	Acacia confusa	120	5	6	FELL	FELL	FELL	
3801	CT912	3801	811604.253	820150.610	台灣相思	Acacia confusa	170	3	7	FELL	FELL	FELL	
3801	CT913	3801	811601.190	820147.756	大葉相思	Acacia mangium	150	3	7	FELL	FELL	FELL	
3801	CT914	3801	811600.852	820149.490	羊蹄甲屬	Bauhinia spp.	100	4	5	FELL	FELL	FELL	
3801	CT915	3801	811594.236	820151.876	苦楝	Melia azedarach	190	5	7	FELL	FELL	FELL	
3801	CT916	3801	811593.879	820152.722	苦楝	Melia azedarach	140	4	7	FELL	FELL	FELL	
3801	CT917	3801	811670.016	820072.115	羊蹄甲屬	Bauhinia spp.	120	4	7	FELL	FELL	FELL	
3801	CT918	3801	811667.265	820071.504	大葉相思	Acacia mangium	180	3	10	FELL	FELL	FELL	
3801	CT919	3801	811666.338	820069.213	黃槿	Hibiscus tiliaceus	170	7	10	FELL	FELL	FELL	
3801	CT92	3801	811716.807	820139.580	大葉相思	Acacia mangium	110	6	7	FELL	FELL	FELL	
3801	CT920	3801	811665.058	820069.603	黃花夾竹桃	Thevetia peruviana	110	6	8	FELL	FELL	FELL	
3801	CT921	3801	811664.677	820072.149	台灣相思	Acacia confusa	210	5	11	FELL	FELL	FELL	
3801	CT922	3801	811666.505	820075.134	台灣相思	Acacia confusa	140	4	10	FELL	FELL	FELL	
3801	CT923	3801	811665.474	820076.628	台灣相思	Acacia confusa	210	6	10	FELL	FELL	FELL	
3801	CT924	3801	811663.803	820074.288	苦楝	Melia azedarach	280	5	12	FELL	FELL	FELL	
3801	CT925	3801	811662.143	820074.568	苦楝	Melia azedarach	240	3	12	FELL	FELL	FELL	
3801	CT926	3801	811661.820	820076.670	台灣相思	Acacia confusa	180	7	8	FELL	FELL	FELL	
3801	CT927	3801	811661.633	820072.276	台灣相思	Acacia confusa	100	4	7	FELL	FELL	FELL	
3801	CT928	3801	811659.005	820073.211	台灣相思	Acacia confusa	120	4	8	FELL	FELL	FELL	
3801	CT929	3801	811656.636	820075.849	台灣相思	Acacia confusa	100	3	5	FELL	FELL	FELL	
3801	CT93	3801	811713.309	820143.632	銀合歡	Leucaena leucocephala	218	15	9	FELL	FELL	FELL	
3801	CT930	3801	811658.430	820076.247	台灣相思	Acacia confusa	120	4	8	FELL	FELL	FELL	
3801	CT931	3801	811658.357	820077.197	大葉相思	Acacia mangium	290	6	12	FELL	FELL	FELL	
3801	CT933	3801	811657.583	820077.756	台灣相思	Acacia confusa	180	3	12	FELL	FELL	FELL	
3801	CT934	3801	811657.506	820078.760	大葉相思	Acacia mangium	230	4	11	FELL	FELL	FELL	
3801	CT935	3801	811656.423	820079.238	大葉相思	Acacia mangium	140	4	11	FELL	FELL	FELL	
3801	CT937	3801	811656.524	820077.007	台灣相思	Acacia confusa	130	4	8	FELL	FELL	FELL	
3801	CT938	3801	811655.646	820079.505	大葉相思	Acacia mangium	240	4	11	FELL	FELL	FELL	
3801	CT939	3801	811654.826	820077.818	台灣相思	Acacia confusa	100	5	8	FELL	FELL	FELL	
3801	CT94	3801	811713.024	820131.351	台灣相思	Acacia confusa	140	9	10	FELL	FELL	FELL	
3801	CT940	3801	811653.505	820081.248	紅膠木	Lophostemon confertus	100	4	15	FELL	FELL	FELL	
3801	CT941	3801	811654.776	820076.723	台灣相思	Acacia confusa	130	7	7	FELL	FELL	FELL	
3801	CT942	3801	811653.900	820077.304	台灣相思	Acacia confusa	280	7	11	FELL	FELL	FELL	
3801	CT943	3801	811650.929	820079.337	羊蹄甲屬	Bauhinia spp.	120	5	6	FELL	FELL	FELL	
3801	CT944	3801	811648.167	820080.445	羊蹄甲屬	Bauhinia spp.	110	5	7	FELL	FELL	FELL	
3801	CT945	3801	811647.472	820080.151	羊蹄甲屬	Bauhinia spp.	100	7	8	FELL	FELL	FELL	
3801	CT946	3801	811647.460	820080.816	羊蹄甲屬	Bauhinia spp.	150	7	7	FELL	FELL	FELL	
3801	CT947	3801	811646.663	820080.322	羊蹄甲屬	Bauhinia spp.	120	5	10	FELL	FELL	FELL	
3801	CT948	3801	811644.172	820079.271	苦楝	Melia azedarach	390	9	11	FELL	FELL	FELL	
3801	CT949	3801	811643.895	820081.576	台灣相思	Acacia confusa	205	8	9	FELL	FELL	FELL	
3801	CT95	3801	811712.308	820131.465	台灣相思	Acacia confusa	130	5	10	FELL	FELL	FELL	
3801	CT950	3801	811644.415	820081.982	台灣相思	Acacia confusa	120	7	7	FELL	FELL	FELL	
3801	CT951	3801	811644.374	820083.085	大葉相思	Acacia mangium	210	5	11	FELL	FELL	FELL	
3801	CT952	3801	811645.348	820084.083	大葉相思	Acacia mangium	205	5	7	FELL	FELL	FELL	
3801	CT953	3801	811642.829	820084.523	大葉相思	Acacia mangium	230	4	11	FELL	FELL	FELL	
3801	CT954	3801	811642.497	820083.054	台灣相思	Acacia confusa	120	4	8	FELL	FELL	FELL	
3801	CT955	3801	811641.830	820084.715	大葉相思	Acacia mangium	100	3	5	FELL	FELL	FELL	
3801	CT956	3801	811641.135	820083.922	大葉相思	Acacia mangium	290	5	12	FELL	FELL	FELL	
3801	CT957	3801	811641.451	820082.261	台灣相思	Acacia confusa	130	4	8	FELL	FELL	FELL	
3801	CT958	3801	811639.808	820083.258	台灣相思	Acacia confusa	150	4	10	FELL	FELL	FELL	
3801	CT959	3801	811640.123	820084.116	大葉相思	Acacia mangium	140	4	8	FELL	FELL	FELL	
3801	CT96	3801	811711.858	820130.574	台灣相思	Acacia confusa	140	5	9	FELL	FELL	FELL	
3801	CT960	3801	811639.974	820088.710	大葉相思	Acacia mangium	300	6	11	FELL	FELL	FELL	
3801	CT961	3801	811637.927	820085.962	紅膠木	Lophostemon confertus	100	5	8	FELL	FELL	FELL	
3801	CT962	3801	811635.834	820087.092	紅膠木	Lophostemon confertus	100	5	8	FELL	FELL	FELL	
3801	CT963	3801	811636.340	820084.950	羊蹄甲屬	Bauhinia spp.	100	3	8	FELL	FELL	FELL	
3801	CT964	3801	811637.112	820082.146	紅膠木	Lophostemon confertus	120	5	6	FELL	FELL	FELL	
3801	CT965	3801	811631.954	820085.976	台灣相思	Acacia confusa	260	7	12	FELL	FELL	FELL	
3801	CT966	3801	811633.441	820086.855	台灣相思	Acacia confusa	120	4	9	FELL	FELL	FELL	
3801	CT967	3801	811631.858	820086.727	台灣相思	Acacia confusa	120	6	6	FELL	FELL	FELL	
3801	CT968	3801	811632.465	820087.105	台灣相思	Acacia confusa	160	4	11	FELL	FELL	FELL	
3801	CT969	3801	811630.829	820087.183	台灣相思	Acacia confusa	130	5	8	FELL	FELL	FELL	
3801	CT97	3801	811711.245	820131.195	台灣相思	Acacia confusa	170	7	10	FELL	FELL	FELL	
3801	CT970	3801	811631.393	820087.900	台灣相思	Acacia confusa	120	7	7	FELL	FELL	FELL	
3801	CT971	3801	811633.283	820088.061	台灣相思	Acacia confusa	110	5	6	FELL	FELL	FELL	
3801	CT972	3801	811635.631	820089.192	苦楝	Melia azedarach	240	5	12	FELL	FELL	FELL	
3801	CT973	3801	811629.298	820085.653	苦楝	Melia azedarach	220	7	12	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT974	3801	811623.906	820086.085	大葉相思	Acacia mangium	310	5	12	FELL	FELL	FELL	
3801	CT975	3801	811622.994	820086.361	大葉相思	Acacia mangium	140	3	11	FELL	FELL	FELL	
3801	CT976	3801	811623.550	820087.356	大葉相思	Acacia mangium	170	5	11	FELL	FELL	FELL	
3801	CT977	3801	811621.966	820087.134	死樹	Dead tree	170	3	12	FELL	FELL	FELL	
3801	CT978	3801	811623.281	820088.260	大葉相思	Acacia mangium	180	4	11	FELL	FELL	FELL	
3801	CT979	3801	811624.497	820088.077	大葉相思	Acacia mangium	280	8	12	FELL	FELL	FELL	
3801	CT98	3801	811710.313	820131.891	台灣相思	Acacia confusa	150	7	9	FELL	FELL	FELL	
3801	CT980	3801	811624.120	820089.260	大葉相思	Acacia mangium	100	5	7	FELL	FELL	FELL	
3801	CT981	3801	811625.260	820092.836	大葉相思	Acacia mangium	210	4	10	FELL	FELL	FELL	
3801	CT982	3801	811622.968	820092.013	紅膠木	Lophostemon confertus	100	4	6	FELL	FELL	FELL	
3801	CT983	3801	811622.077	820091.055	台灣相思	Acacia confusa	160	6	10	FELL	FELL	FELL	
3801	CT984	3801	811621.398	820090.268	台灣相思	Acacia confusa	100	5	10	FELL	FELL	FELL	
3801	CT985	3801	811621.163	820091.290	台灣相思	Acacia confusa	120	5	6	FELL	FELL	FELL	
3801	CT986	3801	811620.622	820090.790	台灣相思	Acacia confusa	110	5	10	FELL	FELL	FELL	
3801	CT987	3801	811619.796	820090.089	台灣相思	Acacia confusa	190	7	10	FELL	FELL	FELL	
3801	CT988	3801	811619.133	820087.566	大葉相思	Acacia mangium	230	6	12	FELL	FELL	FELL	
3801	CT989	3801	811618.346	820089.535	羊蹄甲屬	Bauhinia spp.	110	3	10	FELL	FELL	FELL	
3801	CT99	3801	811706.145	820136.848	苦楝	Melia azedarach	220	7	9	FELL	FELL	FELL	
3801	CT990	3801	811616.978	820087.816	紅膠木	Lophostemon confertus	110	3	8	FELL	FELL	FELL	
3801	CT991	3801	811617.107	820090.263	羊蹄甲屬	Bauhinia spp.	140	5	10	FELL	FELL	FELL	
3801	CT992	3801	811614.730	820091.061	大葉相思	Acacia mangium	210	3	11	FELL	FELL	FELL	
3801	CT993	3801	811614.324	820090.844	大葉相思	Acacia mangium	130	2	11	FELL	FELL	FELL	
3801	CT994	3801	811613.921	820091.427	大葉相思	Acacia mangium	210	4	9	FELL	FELL	FELL	
3801	CT995	3801	811613.384	820091.001	大葉相思	Acacia mangium	400	9	14	FELL	FELL	FELL	
3801	CT996	3801	811613.115	820088.535	大葉相思	Acacia mangium	410	6	13	FELL	FELL	FELL	
3801	CT997	3801	811611.615	820088.742	羊蹄甲屬	Bauhinia spp.	100	6	8	FELL	FELL	FELL	
3801	CT998	3801	811610.086	820091.235	羊蹄甲屬	Bauhinia spp.	110	5	7	FELL	FELL	FELL	
3801	CT999	3801	811608.617	820089.393	羊蹄甲屬	Bauhinia spp.	100	2	12	FELL	FELL	FELL	
3801	P252/CT305	3801	811786.397	819946.253	垂葉榕	Ficus benjamina	215	5	7	FELL	FELL	FELL	
3801	P252/CT306	3801	811785.442	819950.058	垂葉榕	Ficus benjamina	200	6	7	FELL	FELL	FELL	
3801	P252/CT307	3801	811784.457	819954.052	垂葉榕	Ficus benjamina	225	6	7	FELL	FELL	FELL	
3801	P252/CT308	3801	811783.426	819957.428	垂葉榕	Ficus benjamina	210	6	7	FELL	FELL	FELL	
3801	P252/CT309	3801	811782.225	819961.739	垂葉榕	Ficus benjamina	280	7	7	FELL	FELL	FELL	
3801	P252/CT310	3801	811779.809	819969.496	垂葉榕	Ficus benjamina	210	5	6	FELL	FELL	FELL	
3801	P252/CT311	3801	811778.480	819973.314	垂葉榕	Ficus benjamina	255	6	7	FELL	FELL	FELL	
3801	P252/CT312	3801	811777.481	819977.223	垂葉榕	Ficus benjamina	215	6	7	FELL	FELL	FELL	
3801	P252/CT313	3801	811776.405	819980.743	垂葉榕	Ficus benjamina	225	6	7	FELL	FELL	FELL	
3801	P252/CT314	3801	811770.989	819930.305	垂葉榕	Ficus benjamina	140	3	5	FELL	FELL	FELL	
3801	P252/CT315	3801	811769.878	819933.451	大葉相思	Acacia mangium	220	3	7	FELL	FELL	FELL	
3801	P252/CT316	3801	811757.330	819970.896	大葉相思	Acacia mangium	245	5	8	FELL	FELL	FELL	
3801	P252/CT506	3801	811736.868	820021.775	大葉相思	Acacia mangium	205	4	5	FELL	FELL	FELL	
3801	P252/CT507	3801	811728.866	820034.748	耳果相思	Acacia auriculiformis	160	4	5	FELL	FELL	FELL	
3801	P252/CT508	3801	811725.942	820039.012	大葉相思	Acacia mangium	255	5	7	FELL	FELL	FELL	
3801	P252/CT509	3801	811717.896	820049.460	大葉相思	Acacia mangium	160	4	6	FELL	FELL	FELL	
3801	P252/CT510	3801	811714.594	820053.262	大葉相思	Acacia mangium	220	5	6	FELL	FELL	FELL	
3801	P252/CT511	3801	811711.315	820056.891	耳果相思	Acacia auriculiformis	200	5	7	FELL	FELL	FELL	
3801	P252/CT512	3801	811704.103	820064.238	大葉相思	Acacia mangium	205	5	7	FELL	FELL	FELL	
3801	P252/CT513	3801	811699.979	820068.095	大葉相思	Acacia mangium	205	5	7	FELL	FELL	FELL	
3801	P252/CT514	3801	811692.594	820074.350	大葉相思	Acacia mangium	175	5	6	FELL	FELL	FELL	
3801	P252/CT515	3801	811688.504	820077.506	大葉相思	Acacia mangium	245	5	8	FELL	FELL	FELL	
3801	P252/CT544	3801	811674.863	820053.976	台灣相思	Acacia confusa	175	7	7	FELL	FELL	FELL	
3801	P252/CT545	3801	811675.324	820053.377	台灣相思	Acacia confusa	255	5	11	FELL	FELL	FELL	
3801	P252/CT546	3801	811676.786	820051.154	台灣相思	Acacia confusa	230	8	11	FELL	FELL	FELL	
3801	P252/CT547	3801	811674.578	820053.029	台灣相思	Acacia confusa	130	5	10	FELL	FELL	FELL	
3801	P252/CT548	3801	811676.225	820050.495	台灣相思	Acacia confusa	285	8	11	FELL	FELL	FELL	
3801	P252/CT549	3801	811677.397	820049.129	台灣相思	Acacia confusa	150	5	6	FELL	FELL	FELL	
3801	P252/CT550	3801	811676.920	820049.641	台灣相思	Acacia confusa	250	6	9	FELL	FELL	FELL	
3801	P252/CT551	3801	811678.441	820048.391	台灣相思	Acacia confusa	115	4	6	FELL	FELL	FELL	
3801	P252/CT552	3801	811678.364	820047.144	大葉相思	Acacia mangium	170	3	5	FELL	FELL	FELL	
3801	P252/CT553	3801	811681.041	820038.225	大葉相思	Acacia mangium	135	4	4	FELL	FELL	FELL	
3801	P252/CT554	3801	811678.721	820035.693	大葉相思	Acacia mangium	250	8	10	FELL	FELL	FELL	
3801	P252/CT555	3801	811677.782	820034.753	大葉相思	Acacia mangium	145	5	5	FELL	FELL	FELL	
3801	P252/CT556	3801	811677.084	820042.980	台灣相思	Acacia confusa	110	2	4	FELL	FELL	FELL	
3801	P252/CT558	3801	811674.373	820041.894	台灣相思	Acacia confusa	135	4	7	FELL	FELL	FELL	
3801	P252/CT558A	3801	811673.066	820042.919	苦楝	Melia azedarach	339	6	9	FELL	FELL	FELL	
3801	P252/CT559	3801	811674.194	820039.949	台灣相思	Acacia confusa	190	5	7	FELL	FELL	FELL	
3801	P252/CT560	3801	811675.793	820041.152	洋紫荊	Bauhinia x blakeana	155	5	5	FELL	FELL	FELL	
3801	P282/CT2781	3801	811730.934	819980.528	大葉合歡	Albizia lebbeck	387	5	7	FELL	FELL	FELL	
3801	P282/CT2782	3801	811732.589	819980.236	大葉合歡	Albizia lebbeck	420	7	7	FELL	FELL	FELL	
3801	P282/CT2783	3801	811705.680	819982.670	垂葉榕	Ficus benjamina	330	4	7	FELL	FELL	FELL	
3801	P282/CT2784	3801	811715.065	819959.190	垂葉榕	Ficus benjamina	280	5	8	FELL	FELL	FELL	
3801	P282/CT2785	3801	811710.165	819974.829	垂葉榕	Ficus benjamina	290	4	6	FELL	FELL	FELL	
3801	P282/CT2786	3801	811722.794	819993.266	銀樺	Grevillea robusta	220	2	7	FELL	FELL	FELL	
3801	P282/CT2787	3801	811721.805	819994.885	銀樺	Grevillea robusta	160	2	3	FELL	FELL	FELL	
3801	P282/CT2788	3801	811719.302	819996.355	銀樺	Grevillea robusta	240	3	4	FELL	FELL	FELL	
3801	P282/CT2789	3801	811717.300	819998.983	銀樺	Grevillea robusta	210	3	3	FELL	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	P282/CT2790	3801	811714.266	819999.652	銀樟	<i>Grevillea robusta</i>	110	2	2	FELL	FELL	FELL	
3801	P282/CT2791	3801	811707.011	820006.025	銀樟	<i>Grevillea robusta</i>	130	2	2	FELL	FELL	FELL	
3801	P282/CT2792	3801	811702.827	820008.238	銀樟	<i>Grevillea robusta</i>	220	2	6	FELL	FELL	FELL	
3801	P282/CT2793	3801	811671.180	820035.119	台灣相思	<i>Acacia confusa</i>	215	6	11	FELL	FELL	FELL	
3801	P282/CT2794	3801	811669.341	820036.385	台灣相思	<i>Acacia confusa</i>	190	5	10	FELL	FELL	FELL	
3801	P282/CT2795	3801	811671.386	820037.808	台灣相思	<i>Acacia confusa</i>	151	5	8	FELL	FELL	FELL	
3801	P282/CT2796	3801	811672.821	820036.394	台灣相思	<i>Acacia confusa</i>	167	4	6	FELL	FELL	FELL	
3801	P282/CT2797	3801	811673.009	820039.742	台灣相思	<i>Acacia confusa</i>	145	3	10	FELL	FELL	FELL	
3801	P282/CT2798	3801	811669.020	820030.417	紅花羊蹄甲	<i>Bauhinia purpurea</i>	125	4	6	FELL	FELL	FELL	
3801	P282/CT2799	3801	811664.127	820032.433	台灣相思	<i>Acacia confusa</i>	130	3	7	FELL	FELL	FELL	
3801	P282/CT2800	3801	811661.345	820030.472	台灣相思	<i>Acacia confusa</i>	294	4	11	FELL	FELL	FELL	
3801	P282/CT2801	3801	811663.492	820030.323	台灣相思	<i>Acacia confusa</i>	135	5	9	FELL	FELL	FELL	
3801	P282/CT2802	3801	811661.830	820029.017	台灣相思	<i>Acacia confusa</i>	210	4	10	FELL	FELL	FELL	
3801	P282/CT2803	3801	811659.870	820029.129	台灣相思	<i>Acacia confusa</i>	210	4	11	FELL	FELL	FELL	
3801	P282/CT2804	3801	811658.410	820029.157	台灣相思	<i>Acacia confusa</i>	205	4	5	FELL	FELL	FELL	
3801	P282/CT2805	3801	811657.118	820027.234	台灣相思	<i>Acacia confusa</i>	195	7	8	FELL	FELL	FELL	
3801	P282/CT2806	3801	811655.342	820027.159	台灣相思	<i>Acacia confusa</i>	280	7	9	FELL	FELL	FELL	
3801	P282/CT2807	3801	811657.049	820026.390	台灣相思	<i>Acacia confusa</i>	300	6	8	FELL	FELL	FELL	
3801	P282/CT2808	3801	811658.352	820025.477	苦楝	<i>Melia azedarach</i>	305	5	8	FELL	FELL	FELL	
3801	T4	AAHK	811325.540	817818.640	朴樹	<i>Celtic sinensis</i>	300	8	8	*	Excluded from the Project	Excluded from the Project	Handed over to AAHK in May 2022.
3801	T5	AAHK	811330.920	817809.530	朴樹	<i>Celtic sinensis</i>	201	4	8	*	Excluded from the Project	Excluded from the Project	Handed over to AAHK in May 2022.
3801	T6	3801	811517.000	820156.000	羊蹄甲屬	<i>Bauhinia sp.</i>	100	2	7	*	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1	N/A	811779.400	820047.420	洋紫荊	<i>Bauhinia x blakeana</i>	170	6	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT10	N/A	811778.996	820066.748	黃槿	<i>Hibiscus tiliaceus</i>	260	8	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1194	3801	811656.468	820061.666	黃槿	<i>Hibiscus tiliaceus</i>	130	4	6	TRANSPLANT	TRANSPLANTED and REMOVED eventually	TRANSPLANTED and REMOVED eventually	Removed due to damage by typhoon Higos (18 Aug 2020).
3801	CT1384	N/A	811485.550	820119.160	黃槿	<i>Hibiscus tiliaceus</i>	150	5	7	*	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1385	N/A	811487.838	820119.829	紅膠木	<i>Lophostemon confertus</i>	100	4	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1386	N/A	811491.045	820120.986	大葉相思	<i>Acacia mangium</i>	220	6	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1400	N/A	811504.540	820136.560	黃槿	<i>Hibiscus tiliaceus</i>	110	4	6	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1407	3801	811519.870	820152.010	台灣相思	<i>Acacia confusa</i>	120	5	5	FELL	REMOVED	REMOVED	Removed due to safety concern of Airport Express Line operation.
3801	CT1410	3801	811524.060	820160.860	黃花夾竹桃	<i>Thevetia peruviana</i>	100	5	5	RETAIN	REMOVED	REMOVED	
3801	CT1412	3801	811524.592	820161.933	紅膠木	<i>Lophostemon confertus</i>	260	5	12	RETAIN	REMOVED	REMOVED	
3801	CT1419	3801	811512.250	820154.110	台灣相思	<i>Acacia confusa</i>	100	5	6	FELL	REMOVED	REMOVED	
3801	CT1420	3801	811510.520	820151.960	黃槿	<i>Hibiscus tiliaceus</i>	110	5	5	FELL	REMOVED	REMOVED	
3801	CT1421	3801	811511.670	820153.020	台灣相思	<i>Acacia confusa</i>	100	2	7	FELL	REMOVED	REMOVED	
3801	CT1466	N/A	811461.003	820109.928	台灣相思	<i>Acacia confusa</i>	120	4	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1781	3802	811397.104	820232.882	苦楝	<i>Melia azedarach</i>	220	12	9	*	FELL	FELL	
3801	CT1782	3802	811392.512	820242.437	耳果相思	<i>Acacia auriculiformis</i>	300	5	8	*	FELL	FELL	
3801	CT1783	3802	811391.020	820246.866	苦楝	<i>Melia azedarach</i>	160	8	5	*	FELL	FELL	
3801	CT1784	3802	811385.669	820261.972	苦楝	<i>Melia azedarach</i>	120	8	5	*	FELL	FELL	
3801	CT1785	3802	811385.390	820263.437	耳果相思	<i>Acacia auriculiformis</i>	170	10	7	*	FELL	FELL	
3801	CT1786	3802	811373.311	820257.049	芒果	<i>Mangifera indica</i>	140	5	3	*	REMOVED	REMOVED	
3801	CT1787	3802	811370.279	820266.619	芒果	<i>Mangifera indica</i>	190	8	5	*	FELL	FELL	
3801	CT1788	3802	811374.659	820286.027	細葉榕	<i>Ficus microcarpa</i>	180	9	5	*	FELL	FELL	
3801	CT1789	3802	811376.247	820288.268	耳果相思	<i>Acacia auriculiformis</i>	170	11	6	*	FELL	FELL	
3801	CT1790	3802	811374.306	820297.023	耳果相思	<i>Acacia auriculiformis</i>	130	7	4	*	FELL	FELL	
3801	CT1792	N/A	811729.966	820235.793	小果皂莢	<i>Gleditsia australis</i>	95	5	3	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1793	N/A	811729.532	820239.130	構樹	<i>Broussonetia papyrifera</i>	95	3	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1794	3801	811739.937	820208.692	洋紫荊	<i>Bauhinia x blakeana</i>	230	6	7	TRANSPLANT	TRANSPLANTED and REMOVED eventually	TRANSPLANTED and REMOVED eventually	
3801	CT1795	3801	811739.346	820213.489	洋紫荊	<i>Bauhinia x blakeana</i>	360	6	8	TRANSPLANT	TRANSPLANTED and REMOVED eventually	TRANSPLANTED and REMOVED eventually	
3801	CT1797	N/A	811749.218	820235.896	洋紫荊	<i>Bauhinia x blakeana</i>	210	8	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1802	N/A	811758.456	820248.276	洋紫荊	<i>Bauhinia x blakeana</i>	190	7	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1863	3801	811357.122	817711.776	藍花楸	<i>Jacaranda mimosifolia</i>	120	1	4	RETAIN	REMOVED	REMOVED	
3801	CT1885	AAHK	811353.834	817631.933	鐵刀木	<i>Senna siamea</i>	240	8	4	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Feb 2024.
3801	CT1886	AAHK	811354.984	817636.267	鐵刀木	<i>Senna siamea</i>	300	11	5	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Feb 2024.
3801	CT1887	AAHK	811355.580	817640.384	麻楸	<i>Chukrasia tabularis</i>	120	7	4	RETAIN	Excluded from the Project	Excluded from the Project	Handed over to AAHK in Feb 2024.
3801	CT1889	3802	811422.128	820125.551	紅花羊蹄甲	<i>Bauhinia purpurea</i>	235	6	8	RETAIN	FELL	FELL	
3801	CT1890	3802	811421.577	820124.746	苦楝	<i>Melia azedarach</i>	385	7	13	RETAIN	FELL	FELL	
3801	CT1892	3802	811418.941	820124.187	苦楝	<i>Melia azedarach</i>	345	7	13	RETAIN	FELL	FELL	
3801	CT1893	3802	811418.558	820134.982	銀合歡	<i>Leucaena leucocephala</i>	160	6	10	FELL	FELL	FELL	
3801	CT1894	3802	811415.941	820133.798	大王椰子	<i>Roystonea regia</i>	220	5	11	RETAIN	FELL	FELL	
3801	CT1895	N/A	811417.251	820121.145	紅花羊蹄甲	<i>Bauhinia purpurea</i>	115	4	9	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1896	N/A	811418.101	820118.999	紅花羊蹄甲	<i>Bauhinia purpurea</i>	120	5	8	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1897	3802	811416.715	820123.334	苦楝	<i>Melia azedarach</i>	185	5	12	RETAIN	FELL	FELL	
3801	CT1898	N/A	811415.329	820120.520	台灣相思	<i>Acacia confusa</i>	170	6	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1899	3802	811413.121	820127.276	苦楝	<i>Melia azedarach</i>	190	6	11	RETAIN	FELL	FELL	
3801	CT1900	N/A	811413.444	820132.697	銀合歡	<i>Leucaena leucocephala</i>	240	6	14	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1901	3802	811411.009	820131.884	銀合歡	<i>Leucaena leucocephala</i>	265	6	14	RETAIN	FELL	FELL	
3801	CT1902	3802	811413.450	820119.803	台灣相思	<i>Acacia confusa</i>	115	4	9	RETAIN	FELL	FELL	
3801	CT1904	3802	811409.703	820125.912	台灣相思	<i>Acacia confusa</i>	205	8	12	RETAIN	FELL	FELL	
3801	CT1905	3802	811409.245	820130.943	銀合歡	<i>Leucaena leucocephala</i>	195	6	11	RETAIN	FELL	FELL	
3801	CT1906	3802	811407.373	820130.892	銀合歡	<i>Leucaena leucocephala</i>	100	4	9	RETAIN	FELL	FELL	
3801	CT1907	3802	811406.374	820130.186	銀合歡	<i>Leucaena leucocephala</i>	155	5	11	RETAIN	FELL	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
3801	CT1908	3802	811405.316	820130.175	銀合歡	Leucaena leucocephala	185	6	11	RETAIN	FELL	FELL	
3801	CT1909	3802	811404.951	820130.043	銀合歡	Leucaena leucocephala	195	6	11	RETAIN	FELL	FELL	
3801	CT1910	3802	811403.694	820129.600	銀合歡	Leucaena leucocephala	175	6	11	RETAIN	FELL	FELL	
3801	CT1911	3802	811402.934	820129.352	銀合歡	Leucaena leucocephala	155	7	10	RETAIN	FELL	FELL	
3801	CT1912	3802	811402.151	820129.015	銀合歡	Leucaena leucocephala	175	5	10	RETAIN	FELL	FELL	
3801	CT1913	3802	811404.413	820126.414	苦楝	Melia azedarach	230	7	12	RETAIN	FELL	FELL	
3801	CT1914	3802	811402.489	820125.698	大葉相思	Acacia mangium	265	7	12	RETAIN	FELL	FELL	
3801	CT1916	N/A	811409.750	820118.537	台灣相思	Acacia confusa	120	5	6	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1917	3802	811407.774	820117.712	台灣相思	Acacia confusa	185	6	12	FELL	FELL	FELL	
3801	CT1933	3802	811395.591	820124.989	銀合歡	Leucaena leucocephala	225	8	12	FELL	FELL	FELL	
3801	CT1934	3802	811394.365	820126.533	大王椰子	Roystonea regia	195	3	7	FELL	FELL	FELL	
3801	CT1935	N/A	811391.775	820124.898	大王椰子	Roystonea regia	175	5	8	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1936	N/A	811389.839	820117.859	羊蹄甲屬	Bauhinia spp.	105	5	11	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1937	N/A	811389.384	820119.495	羊蹄甲屬	Bauhinia spp.	160	5	13	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1938	N/A	811387.277	820125.171	大王椰子	Roystonea regia	295	7	13	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1939	N/A	811385.278	820121.629	大王椰子	Roystonea regia	135	4	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1940	N/A	811381.781	820121.993	大王椰子	Roystonea regia	280	5	13	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1941	N/A	811379.316	820119.971	大王椰子	Roystonea regia	175	5	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1942	N/A	811376.816	820119.971	大王椰子	Roystonea regia	280	4	11	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1943	N/A	811386.611	820111.907	羊蹄甲屬	Bauhinia spp.	145	4	14	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1944	N/A	811384.836	820108.993	羊蹄甲屬	Bauhinia spp.	125	3	8	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1945	N/A	811383.257	820110.775	大葉相思	Acacia mangium	185	4	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1946	N/A	811384.182	820112.194	大葉相思	Acacia mangium	190	6	12	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1947	N/A	811380.318	820110.963	苦楝	Melia azedarach	365	8	12	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1948	N/A	811379.908	820110.229	苦楝	Melia azedarach	250	7	11	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT1949	N/A	811381.211	820110.008	大葉相思	Acacia mangium	245	7	11	FELL	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT25	N/A	811765.890	820102.090	黃槿	Hibiscus tiliaceus	350	8	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT26	N/A	811762.970	820103.290	黃槿	Hibiscus tiliaceus	210	4	8	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT3	N/A	811777.300	820054.800	洋紫荊	Bauhinia x blakeana	117	8	6	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT4	N/A	811776.990	820058.030	洋紫荊	Bauhinia x blakeana	130	7	5	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT5	N/A	811777.050	820062.150	黃槿	Hibiscus tiliaceus	350	10	9	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT6	N/A	811772.600	820062.760	黃槿	Hibiscus tiliaceus	340	8	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT7	N/A	811771.720	820066.210	黃槿	Hibiscus tiliaceus	360	11	10	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3801	CT8	N/A	811774.646	820069.519	黃槿	Hibiscus tiliaceus	660	11	11	RETAIN	Not under 3RS contract works area	Not under 3RS contract works area	
3802	ESW001	3802	811355.878	820280.068	番石榴	Psidium guajava	250	7	8	*	FELL	FELL	
3802	ESW002	3802	811358.763	820281.225	苦楝	Melia azedarach	170	8	8	*	FELL	FELL	
3802	ESW003	3802	811370.340	820266.583	苦楝	Melia azedarach	100	6	5	*	FELL	FELL	
3802	ESW004	3802	811358.218	820227.985	細葉榕	Ficus microcarpa	150	8	6	*	FELL	FELL	
3802	T002	3802	811399.004	820126.502	銀合歡	Leucaena leucocephala	160	4	8	*	FELL	FELL	
3802	T005	3802	811397.729	820125.602	銀合歡	Leucaena leucocephala	160	4	8	*	FELL	FELL	
3802	T011	3802	811412.267	820133.294	黃花夾竹桃	Thevetia peruviana	100	4	6	*	FELL	FELL	
3802	T022	3802	811410.119	820128.730	銀合歡	Leucaena leucocephala	100	4	6	*	FELL	FELL	
3802	T030	3802	811419.596	820122.636	宮粉羊蹄甲	Bauhinia variegata	100	3	4	*	FELL	FELL	
3802	T031	3802	811418.214	820122.689	宮粉羊蹄甲	Bauhinia variegata	110	4	5	*	FELL	FELL	
3802	AT1	3802	811378.106	820243.758	細葉榕	Ficus microcarpa	700	6	7	*	FELL	FELL	
3802	AT2	3802	811401.388	820223.811	苦楝	Melia azedarach	300	4	9	*	FELL	FELL	
3802	AT3	3802	811372.285	820309.262	耳果相思	Acacia auriculiformis	170	4	7	*	FELL	FELL	
3802	AT4	3802	811449.757	820186.097	苦楝	Melia azedarach	300	5	9	*	FELL	FELL	
3802	AT5	3802	811466.876	820192.065	愛氏松	Pinus elliotii	130	3	6	*	FELL	FELL	
3802	AT6	3802	811527.327	820166.261	潺槁樹	Litsea glutinosa	150	5	8	*	FELL	FELL	
CLP 132kV	Section 3 - T177	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium Willd	206	3	8	*	N/A	FELL	
CLP 132kV	Section 3 - T178	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium Willd	319	5	10	*	N/A	FELL	
CLP 132kV	Section 3 - T179	CLP 132kV	N/A	N/A	紅膠木	Lophostemon confertus	157	2	9	*	N/A	FELL	
CLP 132kV	Section 3 - T181	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	162	2	5	*	N/A	FELL	
CLP 132kV	Section 3 - T182	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	255	5	8	*	N/A	FELL	
CLP 132kV	Section 3 - T183	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	176	5	8	*	N/A	FELL	
CLP 132kV	Section 3 - T184	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	114	2	7	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T001	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	140	4	6	*	N/A	FELL	
CLP 132kV	Section 4 - T002	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	144	5	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T003	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	182	6.5	6.7	*	N/A	FELL	
CLP 132kV	Section 4 - T004	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	146	4.5	5	*	N/A	FELL	
CLP 132kV	Section 4 - T005	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	197	6.5	6	*	N/A	FELL	
CLP 132kV	Section 4 - T006	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	259	9	8.5	*	N/A	FELL	
CLP 132kV	Section 4 - T007	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	163	6.5	6	*	N/A	FELL	
CLP 132kV	Section 4 - T008	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	154	7	7	*	N/A	FELL	
CLP 132kV	Section 4 - T009	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	227	8.5	8.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T010	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	170	6	8	*	N/A	FELL	
CLP 132kV	Section 4 - T011	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	125	4	7.5	*	N/A	FELL	
CLP 132kV	Section 4 - T012	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	116	3	7.5	*	N/A	FELL	
CLP 132kV	Section 4 - T013	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	196	9	8	*	N/A	FELL	
CLP 132kV	Section 4 - T014	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	199	8.5	8.5	*	N/A	FELL	
CLP 132kV	Section 4 - T015	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	214	10	8	*	N/A	FELL	
CLP 132kV	Section 4 - T016	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	236	7	9	*	N/A	FELL	
CLP 132kV	Section 4 - T017	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	208	6	8	*	N/A	FELL	
CLP 132kV	Section 4 - T018	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	273	8	7	*	N/A	FELL	
CLP 132kV	Section 4 - T019	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	201	7	7	*	N/A	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
CLP 132kV	Section 4 - T020	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	145	6	5	*	N/A	FELL	
CLP 132kV	Section 4 - T021	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	174	6.5	6	*	N/A	FELL	
CLP 132kV	Section 4 - T022	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	121	5	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T023	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	246	6	8.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T024	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	115	5	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T025	CLP 132kV	N/A	N/A	死樹	DEAD TREE	104	3.5	7	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T026	CLP 132kV	N/A	N/A	死樹	DEAD TREE	181	4.5	6	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T027	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	260	9.5	8.5	*	N/A	FELL	
CLP 132kV	Section 4 - T028	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	106	2.5	4	*	N/A	FELL	
CLP 132kV	Section 4 - T029	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	195	6	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T030	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	277	8	7	*	N/A	FELL	
CLP 132kV	Section 4 - T031	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	377	9	7	*	N/A	FELL	
CLP 132kV	Section 4 - T032	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	304	10	7	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T033	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	169	4.5	5	*	N/A	FELL	
CLP 132kV	Section 4 - T034	CLP 132kV	N/A	N/A	朴樹	Celtis sinensis	160	5	6	*	N/A	FELL	
CLP 132kV	Section 4 - T035	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	126	6.5	5	*	N/A	FELL	
CLP 132kV	Section 4 - T037	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	101	7	5	*	N/A	FELL	
CLP 132kV	Section 4 - T038	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	151	6	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T043	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	101	2.5	8	*	N/A	FELL	
CLP 132kV	Section 4 - T044	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	100	2	7.5	*	N/A	FELL	
CLP 132kV	Section 4 - T050	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	306	9	10	*	N/A	FELL	
CLP 132kV	Section 4 - T053	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	190	4	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T055	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	288	8	10	*	N/A	FELL	
CLP 132kV	Section 4 - T056	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	203	8	10	*	N/A	FELL	
CLP 132kV	Section 4 - T060	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	96	2	7.5	*	N/A	FELL	
CLP 132kV	Section 4 - T061	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	164	2	7	*	N/A	FELL	
CLP 132kV	Section 4 - T062	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	149	2.5	8	*	N/A	FELL	
CLP 132kV	Section 4 - T063	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	137	2	8	*	N/A	FELL	
CLP 132kV	Section 4 - T064	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	126	2.5	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T065	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	195	4	8	*	N/A	FELL	
CLP 132kV	Section 4 - T066	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	169	4	7	*	N/A	FELL	
CLP 132kV	Section 4 - T067	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	182	5	6.5	*	N/A	FELL	
CLP 132kV	Section 4 - T068	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	164	6	9	*	N/A	FELL	
CLP 132kV	Section 4 - T072	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	168	2.5	6	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T076	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	109	4.5	635	*	N/A	FELL	
CLP 132kV	Section 4 - T082	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	282	3.5	10	*	N/A	FELL	
CLP 132kV	Section 4 - T083	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	269	4	10	*	N/A	FELL	
CLP 132kV	Section 4 - T084	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	203	3	8	*	N/A	FELL	
CLP 132kV	Section 4 - T085	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	134	2	7	*	N/A	FELL	
CLP 132kV	Section 4 - T086	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	195	3	10	*	N/A	FELL	
CLP 132kV	Section 4 - T087	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	115	1.5	9	*	N/A	FELL	
CLP 132kV	Section 4 - T088	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	184	3	9	*	N/A	FELL	
CLP 132kV	Section 4 - T089	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	267	5	8	*	N/A	FELL	
CLP 132kV	Section 4 - T091	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	104	1.5	5	*	N/A	FELL	
CLP 132kV	Section 4 - T092	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	105	2	5	*	N/A	FELL	
CLP 132kV	Section 4 - T093	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	308	8	9	*	N/A	FELL	
CLP 132kV	Section 4 - T094	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	146	2	6	*	N/A	FELL	
CLP 132kV	Section 4 - T095	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	209	4	9	*	N/A	FELL	
CLP 132kV	Section 4 - T096	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	103	2	4	*	N/A	FELL	
CLP 132kV	Section 4 - T097	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	186	4	9	*	N/A	FELL	
CLP 132kV	Section 4 - T098	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	165	3	8	*	N/A	FELL	
CLP 132kV	Section 4 - T099	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	114	2	6	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T100	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	274	6	8	*	N/A	FELL	
CLP 132kV	Section 4 - T101	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	109	3	5	*	N/A	FELL	
CLP 132kV	Section 4 - T102	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	96	2.5	5	*	N/A	FELL	
CLP 132kV	Section 4 - T103	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	108	2	4	*	N/A	FELL	
CLP 132kV	Section 4 - T104	CLP 132kV	N/A	N/A	死樹	DEAD TREE	114	1	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T111	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	95	2	4	*	N/A	FELL	
CLP 132kV	Section 4 - T112	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	110	1.5	4	*	N/A	FELL	
CLP 132kV	Section 4 - T114	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	383	10	9	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T115	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	221	6	7	*	N/A	FELL	
CLP 132kV	Section 4 - T116	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	100	2	5	*	N/A	FELL	
CLP 132kV	Section 4 - T117	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	144	3	6	*	N/A	FELL	
CLP 132kV	Section 4 - T118	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	183	3	8	*	N/A	FELL	
CLP 132kV	Section 4 - T119	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	113	2	6	*	N/A	FELL	
CLP 132kV	Section 4 - T120	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	125	2	5	*	N/A	FELL	
CLP 132kV	Section 4 - T121	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	118	3	3.5	*	N/A	FELL	
CLP 132kV	Section 4 - T122	CLP 132kV	N/A	N/A	耳果相思	Melia azedarach	323	9	8	*	N/A	FELL	
CLP 132kV	Section 4 - T123	CLP 132kV	N/A	N/A	耳果相思	Melia azedarach	200	6	8	*	N/A	FELL	
CLP 132kV	Section 4 - T124	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	143	2	5	*	N/A	FELL	
CLP 132kV	Section 4 - T125	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	127	2	5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T126	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	183	6	7	*	N/A	FELL	
CLP 132kV	Section 4 - T127	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	128	2	6	*	N/A	FELL	
CLP 132kV	Section 4 - T128	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	203	6	6	*	N/A	FELL	
CLP 132kV	Section 4 - T129	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	160	3	7	*	N/A	FELL	
CLP 132kV	Section 4 - T130	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	176	3	8	*	N/A	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
CLP 132kV	Section 4 - T131	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	241	5	6	*	N/A	FELL	
CLP 132kV	Section 4 - T132	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	195	5	5	*	N/A	FELL	
CLP 132kV	Section 4 - T133	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	177	3	7	*	N/A	FELL	
CLP 132kV	Section 4 - T134	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	118	3	4	*	N/A	FELL	
CLP 132kV	Section 4 - T135	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	101	2	5	*	N/A	FELL	
CLP 132kV	Section 4 - T136	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	143	2	5	*	N/A	FELL	
CLP 132kV	Section 4 - T137	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	160	3	5	*	N/A	FELL	
CLP 132kV	Section 4 - T138	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	374	6	9	*	N/A	FELL	
CLP 132kV	Section 4 - T139	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	170	3	7	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T140	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	119	1.5	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T141	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	125	1.5	4	*	N/A	FELL	
CLP 132kV	Section 4 - T142	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	229	4	7	*	N/A	FELL	
CLP 132kV	Section 4 - T143	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	108	2	4	*	N/A	FELL	
CLP 132kV	Section 4 - T144	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	202	4	8	*	N/A	FELL	
CLP 132kV	Section 4 - T145	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	229	6	7	*	N/A	FELL	
CLP 132kV	Section 4 - T146	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	186	6	7	*	N/A	FELL	
CLP 132kV	Section 4 - T147	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	177	4	8	*	N/A	FELL	
CLP 132kV	Section 4 - T148	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	155	3	8	*	N/A	FELL	
CLP 132kV	Section 4 - T149	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	152	4	7	*	N/A	FELL	
CLP 132kV	Section 4 - T150	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	250	4	8	*	N/A	FELL	
CLP 132kV	Section 4 - T151	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	304	9	11	*	N/A	FELL	
CLP 132kV	Section 4 - T152	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	179	3	6	*	N/A	FELL	
CLP 132kV	Section 4 - T153	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	120	4	4	*	N/A	FELL	
CLP 132kV	Section 4 - T154	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	279	7	8	*	N/A	FELL	
CLP 132kV	Section 4 - T155	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	101	2	3	*	N/A	FELL	
CLP 132kV	Section 4 - T156	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	199	7	9	*	N/A	FELL	
CLP 132kV	Section 4 - T157	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	98	2	3	*	N/A	FELL	
CLP 132kV	Section 4 - T158	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	147	4	9	*	N/A	FELL	
CLP 132kV	Section 4 - T159	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	244	7	7	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T160	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	124	3	4	*	N/A	FELL	
CLP 132kV	Section 4 - T162	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	102	3	4	*	N/A	FELL	
CLP 132kV	Section 4 - T163	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	183	10	8	*	N/A	FELL	
CLP 132kV	Section 4 - T164	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	307	5	8	*	N/A	FELL	
CLP 132kV	Section 4 - T165	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	230	7	8	*	N/A	FELL	
CLP 132kV	Section 4 - T166	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	131	3	4	*	N/A	FELL	
CLP 132kV	Section 4 - T167	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	205	8	6	*	N/A	FELL	
CLP 132kV	Section 4 - T168	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	282	7	8	*	N/A	FELL	
CLP 132kV	Section 4 - T169	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	113	3	7	*	N/A	FELL	
CLP 132kV	Section 4 - T170	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	194	7	8	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 4 - T171	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	160	6	6	*	N/A	FELL	
CLP 132kV	Section 4 - T172	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	249	4	8	*	N/A	FELL	
CLP 132kV	Section 4 - T173	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	190	3	7	*	N/A	FELL	
CLP 132kV	Section 4 - T174	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	128	3	4	*	N/A	FELL	
CLP 132kV	Section 5 - T001	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	174	8	7	*	N/A	RETAIN	
CLP 132kV	Section 5 - T002	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	232	8	8	*	N/A	RETAIN	
CLP 132kV	Section 5 - T003	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	240	8	4	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T004	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	125	6	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T005	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	182	8.5	4	*	N/A	FELL	
CLP 132kV	Section 5 - T006	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	130	8	6	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T007	CLP 132kV	N/A	N/A	木麻黃	Casuarina equisetifolia	143	8	3	*	N/A	RETAIN	
CLP 132kV	Section 5 - T008	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	198	8.5	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T009	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	111	6	3	*	N/A	FELL	
CLP 132kV	Section 5 - T010	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	142	6	4	*	N/A	FELL	
CLP 132kV	Section 5 - T011	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	163	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T012	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	205	6	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T013	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	176	5	4.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T014	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	140	5	4.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T015	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	163	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T016	CLP 132kV	N/A	N/A	大葉合歡	Albizia lebbeck	101	6	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T017	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	137	4.5	4.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T018	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	118	6	6	*	N/A	FELL	
CLP 132kV	Section 5 - T019	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	220	8	4.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T020	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	161	9	3	*	N/A	RETAIN	
CLP 132kV	Section 5 - T021	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	111	8	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T022	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	129	7	3	*	N/A	FELL	
CLP 132kV	Section 5 - T023	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	123	7	4.5	*	N/A	REMOVED	Removed due to damage by typhoon Whipa (23 Aug 2025).
CLP 132kV	Section 5 - T024	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	179	8	6	*	N/A	REMOVED	Removed due to damage by typhoon Whipa (23 Aug 2025).
CLP 132kV	Section 5 - T025	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	142	3	4	*	N/A	REMOVED	Removed due to damage by typhoon Whipa (23 Aug 2025).
CLP 132kV	Section 5 - T026	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	195	7	5.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T027	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	130	6	4	*	N/A	FELL	
CLP 132kV	Section 5 - T028	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	173	5	6	*	N/A	FELL	
CLP 132kV	Section 5 - T029	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	140	5	6	*	N/A	FELL	
CLP 132kV	Section 5 - T030	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	95	4.5	4	*	N/A	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
CLP 132kV	Section 5 - T031	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	197	7	6.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T032	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	197	5	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T033	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	95	4	2.5	*	N/A	FELL	
CLP 132kV	Section 5 - T034	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	130	6	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T035	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	120	6	3	*	N/A	FELL	
CLP 132kV	Section 5 - T036	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	151	8	4	*	N/A	FELL	
CLP 132kV	Section 5 - T037	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	168	8	5	*	N/A	FELL	
CLP 132kV	Section 5 - T038	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	147	5	3	*	N/A	FELL	
CLP 132kV	Section 5 - T039	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	100	8	3	*	N/A	FELL	
CLP 132kV	Section 5 - T040	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	165	8	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T041	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	175	5	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T042	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	144	8	4	*	N/A	FELL	
CLP 132kV	Section 5 - T043	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	123	7.5	4	*	N/A	FELL	
CLP 132kV	Section 5 - T044	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	220	6	6	*	N/A	FELL	
CLP 132kV	Section 5 - T045	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	190	8	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T046	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	125	6	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T047	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	155	6	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T048	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	179	8	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T049	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	100	6	3.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T050	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	211	6	7	*	N/A	FELL	
CLP 132kV	Section 5 - T051	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	173	4.5	5	*	N/A	FELL	
CLP 132kV	Section 5 - T052	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	99	5	4	*	N/A	FELL	
CLP 132kV	Section 5 - T053	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	120	5	4	*	N/A	FELL	
CLP 132kV	Section 5 - T054	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium	173	6	4	*	N/A	REMOVED	Confirmed dead and removed (29 Dec 2025).
CLP 132kV	Section 5 - T055	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	95	5	3	*	N/A	RETAIN	
CLP 132kV	Section 5 - T056	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	109	5	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T057	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	118	5	4	*	N/A	FELL	
CLP 132kV	Section 5 - T058	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	95	6.5	3	*	N/A	FELL	
CLP 132kV	Section 5 - T059	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	215	6.5	6	*	N/A	FELL	
CLP 132kV	Section 5 - T060	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	182	7	6.5	*	N/A	FELL	
CLP 132kV	Section 5 - T061	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	166	6	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T062	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	138	6	4	*	N/A	FELL	
CLP 132kV	Section 5 - T063	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	165	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T064	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	180	6	6	*	N/A	REMOVED	Removed due to damage by typhoon Ragasa (4 Nov 2025).
CLP 132kV	Section 5 - T065	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	95	6.5	2.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T066	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	126	6.5	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T067	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	106	6	2.5	*	N/A	FELL	
CLP 132kV	Section 5 - T068	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	115	5	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T069	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	103	6	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T070	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	122	7	4	*	N/A	FELL	
CLP 132kV	Section 5 - T071	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	154	8	6	*	N/A	FELL	
CLP 132kV	Section 5 - T072	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	122	4.5	3	*	N/A	RETAIN	
CLP 132kV	Section 5 - T073	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	134	7	4	*	N/A	FELL	
CLP 132kV	Section 5 - T074	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	186	8	4	*	N/A	FELL	
CLP 132kV	Section 5 - T075	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	138	6	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T076	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	174	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T077	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	124	6	4	*	N/A	FELL	
CLP 132kV	Section 5 - T078	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	120	6	4	*	N/A	FELL	
CLP 132kV	Section 5 - T079	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	163	6	6	*	N/A	FELL	
CLP 132kV	Section 5 - T080	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	135	6.5	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T081	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	109	6	3	*	N/A	FELL	
CLP 132kV	Section 5 - T082	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	164	5	3.5	*	N/A	FELL	
CLP 132kV	Section 5 - T083	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	151	4.5	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T084	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	155	4.5	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T085	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	133	7	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T086	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	95	5	2.5	*	N/A	FELL	
CLP 132kV	Section 5 - T087	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	194	8	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T088	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	165	8	6	*	N/A	FELL	
CLP 132kV	Section 5 - T089	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	221	8	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T090	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	186	8	4	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T091	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	131	7	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T092	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	122	6.5	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T093	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	245	6	6	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T094	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	218	8	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T095	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	241	8	5	*	N/A	REMOVED	Removed due to damage by typhoon Ragasa (29 Dec 2025).
CLP 132kV	Section 5 - T096	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	201	8	6	*	N/A	FELL	
CLP 132kV	Section 5 - T097	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	190	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T098	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	189	7	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T099	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	143	6	4.5	*	N/A	FELL	
CLP 132kV	Section 5 - T100	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	284	7	8	*	N/A	FELL	
CLP 132kV	Section 5 - T101	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	191	7	8	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T102	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	245	7	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T103	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	189	8	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T104	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	225	8	5	*	N/A	RETAIN	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
CLP 132kV	Section 5 - T105	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	255	7	6.5	*	N/A	FELL	
CLP 132kV	Section 5 - T106	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	173	8	6	*	N/A	FELL	
CLP 132kV	Section 5 - T107	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	139	5	5.5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T108	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	195	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T109	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	104	4	4	*	N/A	FELL	
CLP 132kV	Section 5 - T110	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	122	5	6	*	N/A	FELL	
CLP 132kV	Section 5 - T111	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	164	6.5	6	*	N/A	FELL	
CLP 132kV	Section 5 - T112	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	194	7	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T113	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	202	7	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T114	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	145	7	4	*	N/A	FELL	
CLP 132kV	Section 5 - T115	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	182	7	5	*	N/A	FELL	
CLP 132kV	Section 5 - T116	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	174	7	3	*	N/A	FELL	
CLP 132kV	Section 5 - T117	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	170	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T118	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	147	6.5	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T119	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	177	6.5	5	*	N/A	FELL	
CLP 132kV	Section 5 - T120	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	184	7	4	*	N/A	FELL	
CLP 132kV	Section 5 - T121	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	143	5.5	3	*	N/A	FELL	
CLP 132kV	Section 5 - T122	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	168	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T123	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	116	6.5	3	*	N/A	FELL	
CLP 132kV	Section 5 - T124	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	183	6.5	6	*	N/A	FELL	
CLP 132kV	Section 5 - T125	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	176	6.5	5	*	N/A	FELL	
CLP 132kV	Section 5 - T126	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	245	5.5	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T127	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	155	4.5	3	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T128	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	132	7	4	*	N/A	FELL	
CLP 132kV	Section 5 - T129	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	127	4	4	*	N/A	FELL	
CLP 132kV	Section 5 - T130	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	141	6	6	*	N/A	FELL	
CLP 132kV	Section 5 - T131	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	252	7	8	*	N/A	FELL	
CLP 132kV	Section 5 - T132	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	158	7	8	*	N/A	FELL	
CLP 132kV	Section 5 - T133	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	169	6	5	*	N/A	REMOVED	Confirmed dead and removed (29 Dec 2025).
CLP 132kV	Section 5 - T134	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	202	8	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T135	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	260	7	6	*	N/A	RETAIN	
CLP 132kV	Section 5 - T136	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	191	7	6	*	N/A	FELL	
CLP 132kV	Section 5 - T137	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	260	8	8	*	N/A	FELL	
CLP 132kV	Section 5 - T138	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	269	5	9	*	N/A	FELL	
CLP 132kV	Section 5 - T139	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	253	7.5	8.5	*	N/A	FELL	
CLP 132kV	Section 5 - T140	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	134	6.5	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T141	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	256	7	8.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 5 - T142	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	140	7	5	*	N/A	RETAIN	
CLP 132kV	Section 5 - T143	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	261	7	9	*	N/A	FELL	
CLP 132kV	Section 5 - T144	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	212	8	8	*	N/A	FELL	
CLP 132kV	Section 5 - T145	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	98	5	2	*	N/A	FELL	
CLP 132kV	Section 5 - T146	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	126	8	4	*	N/A	RETAIN	
CLP 132kV	Section 5 - T147	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	163	8	7	*	N/A	FELL	
CLP 132kV	Section 5 - T148	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	155	7	3	*	N/A	RETAIN	
CLP 132kV	Section 6 - T001	CLP 132kV	N/A	N/A	海芒果	Cerbera manghas	254	5	5	*	N/A	FELL	
CLP 132kV	Section 6 - T002	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	278	9	7	*	N/A	FELL	
CLP 132kV	Section 6 - T003	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	146	3	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T004	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	147	5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T005	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	155	3	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T006	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	185	8	6	*	N/A	FELL	
CLP 132kV	Section 6 - T007	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	190	5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T008	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	117	3	4	*	N/A	FELL	
CLP 132kV	Section 6 - T010	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	129	5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T011	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	182	5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T012	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	209	4.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T013	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	157	5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T014	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	193	4.5	7.5	*	N/A	FELL	
CLP 132kV	Section 6 - T015	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	204	5.5	7.5	*	N/A	FELL	
CLP 132kV	Section 6 - T016	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	113	4	6	*	N/A	FELL	
CLP 132kV	Section 6 - T017	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	126	5	9.5	*	N/A	FELL	
CLP 132kV	Section 6 - T018	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	117	4	8	*	N/A	FELL	
CLP 132kV	Section 6 - T019	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	232	6.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T020	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	173	8.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T022	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	194	6.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T023	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	195	9	7	*	N/A	FELL	
CLP 132kV	Section 6 - T024	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	130	3.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T025	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	126	4.5	10	*	N/A	FELL	
CLP 132kV	Section 6 - T026	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	118	2.5	4.5	*	N/A	FELL	
CLP 132kV	Section 6 - T027	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	104	2.5	4	*	N/A	FELL	
CLP 132kV	Section 6 - T028	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	167	4.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T029	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	142	4.5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T030	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	122	2.5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T031	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	138	4.5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T032	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	168	7	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T033	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	102	3.5	3	*	N/A	FELL	
CLP 132kV	Section 6 - T034	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	177	6	5.5	*	N/A	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
CLP 132kV	Section 6 - T035	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	119	2	4.5	*	N/A	FELL	
CLP 132kV	Section 6 - T037	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	120	6	5	*	N/A	FELL	
CLP 132kV	Section 6 - T038	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	186	5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T039	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	125	6	8	*	N/A	FELL	
CLP 132kV	Section 6 - T041	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	196	6.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T042	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	184	3.5	11	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T043	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	118	4	8.5	*	N/A	FELL	
CLP 132kV	Section 6 - T044	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	224	4	10	*	N/A	FELL	
CLP 132kV	Section 6 - T045	CLP 132kV	N/A	N/A	大葉合歡	Albizia lebeck	372	8.5	11.5	*	N/A	FELL	
CLP 132kV	Section 6 - T046	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	95	3	4	*	N/A	FELL	
CLP 132kV	Section 6 - T047	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	120	4.5	4	*	N/A	FELL	
CLP 132kV	Section 6 - T048	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	257	7	11	*	N/A	FELL	
CLP 132kV	Section 6 - T049	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	137	5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T050	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	152	2.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T052	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	233	4.5	10.5	*	N/A	FELL	
CLP 132kV	Section 6 - T053	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	144	4.5	4.5	*	N/A	FELL	
CLP 132kV	Section 6 - T054	CLP 132kV	N/A	N/A	木麻黃	Casuarina equisetifolia	175	4.5	6	*	N/A	FELL	
CLP 132kV	Section 6 - T055	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	223	4.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T056	CLP 132kV	N/A	N/A	大葉合歡	Albizia lebeck	233	4	6	*	N/A	FELL	
CLP 132kV	Section 6 - T057	CLP 132kV	N/A	N/A	大葉合歡	Albizia lebeck	103	2.5	6	*	N/A	FELL	
CLP 132kV	Section 6 - T058	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	319	8.5	10	*	N/A	FELL	
CLP 132kV	Section 6 - T059	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	169	4.5	8	*	N/A	FELL	
CLP 132kV	Section 6 - T060	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	304	6	11	*	N/A	FELL	
CLP 132kV	Section 6 - T061	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	121	4.5	9	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T062	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	129	3.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T063	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	169	5	8	*	N/A	FELL	
CLP 132kV	Section 6 - T064	CLP 132kV	N/A	N/A	大葉合歡	Albizia lebeck	154	4	8	*	N/A	FELL	
CLP 132kV	Section 6 - T065	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	105	2.5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T066	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	131	4.5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T067	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	208	4.5	9.5	*	N/A	FELL	
CLP 132kV	Section 6 - T068	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	153	2.5	9.5	*	N/A	FELL	
CLP 132kV	Section 6 - T069	CLP 132kV	N/A	N/A	海芒果	Cerbera manghas	249	4.5	5	*	N/A	FELL	
CLP 132kV	Section 6 - T070	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	200	4.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T071	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	97	3.5	4.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T072	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	133	4.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T073	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	142	4.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T074	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	144	4.5	9	*	N/A	FELL	
CLP 132kV	Section 6 - T075	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	168	6	7	*	N/A	FELL	
CLP 132kV	Section 6 - T076	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	170	4	7	*	N/A	FELL	
CLP 132kV	Section 6 - T078	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium	244	8	11	*	N/A	FELL	
CLP 132kV	Section 6 - T079	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium	213	4.5	11	*	N/A	FELL	
CLP 132kV	Section 6 - T080	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	172	4	11	*	N/A	FELL	
CLP 132kV	Section 6 - T083	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	122	4	9	*	N/A	FELL	
CLP 132kV	Section 6 - T084	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium	272	7	11	*	N/A	FELL	
CLP 132kV	Section 6 - T085	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	126	4	5	*	N/A	FELL	
CLP 132kV	Section 6 - T086	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	153	4	5	*	N/A	FELL	
CLP 132kV	Section 6 - T087	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	151	4.5	10	*	N/A	FELL	
CLP 132kV	Section 6 - T088	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	125	4.5	10	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T090	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	188	5	10	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T091	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	164	4.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T092	CLP 132kV	N/A	N/A	死樹	DEAD TREE	100	1.5	2.5	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T093	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	239	4.5	8	*	N/A	FELL	
CLP 132kV	Section 6 - T094	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	231	4.5	8	*	N/A	FELL	
CLP 132kV	Section 6 - T095	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	135	3	4.5	*	N/A	FELL	
CLP 132kV	Section 6 - T096	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	146	6.5	4.5	*	N/A	FELL	
CLP 132kV	Section 6 - T097	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	221	4	5	*	N/A	FELL	
CLP 132kV	Section 6 - T098	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	115	4	5	*	N/A	FELL	
CLP 132kV	Section 6 - T099	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	182	4	5.5	*	N/A	FELL	
CLP 132kV	Section 6 - T100	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	172	5	5.5	*	N/A	FELL	
CLP 132kV	Section 6 - T101	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	194	5	6	*	N/A	FELL	
CLP 132kV	Section 6 - T102	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	146	4.5	5	*	N/A	FELL	
CLP 132kV	Section 6 - T103	CLP 132kV	N/A	N/A	耳果相思	Acacia auriculiformis	122	2.5	6	*	N/A	FELL	
CLP 132kV	Section 6 - T105	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	179	6	7	*	N/A	FELL	
CLP 132kV	Section 6 - T106	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	125	2.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T107	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	99	4	5	*	N/A	FELL	
CLP 132kV	Section 6 - T108	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	298	6	8	*	N/A	FELL	
CLP 132kV	Section 6 - T109	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	174	6.5	8	*	N/A	FELL	
CLP 132kV	Section 6 - T110	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	150	3	8	*	N/A	FELL	
CLP 132kV	Section 6 - T111	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	113	3.5	8	*	N/A	FELL	
CLP 132kV	Section 6 - T112	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	155	3	8	*	N/A	REMOVED	Removed by others (initial survey)
CLP 132kV	Section 6 - T115	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	140	1.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T116	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	146	2	7	*	N/A	FELL	
CLP 132kV	Section 6 - T117	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	131	2	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T118	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	177	4	7	*	N/A	FELL	
CLP 132kV	Section 6 - T119	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	132	5	7.5	*	N/A	FELL	
CLP 132kV	Section 6 - T120	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	129	4.5	3	*	N/A	FELL	

Contracts	Tree ID	Current Maintenance Agency	Easting	Northing	Chinese Name	Latin Name	Tree Measurement			Recommendation in LVP (Jan 2021)	Status as of end 2024	Status as of end 2025	Remark
							DBH (mm)	Crown Spread (m)	Height (m)				
CLP 132kV	Section 6 - T121	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	269	8.5	7.5	*	N/A	FELL	
CLP 132kV	Section 6 - T122	CLP 132kV	N/A	N/A	大葉相思	Acacia mangium	134	2.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T123	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	145	3	6	*	N/A	FELL	
CLP 132kV	Section 6 - T124	CLP 132kV	N/A	N/A	宮粉羊蹄甲	Bauhinia variegata	190	4	8	*	N/A	FELL	
CLP 132kV	Section 6 - T128	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	140	2.5	4.5	*	N/A	FELL	
CLP 132kV	Section 6 - T129	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	152	4.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T132	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	138	4.5	5	*	N/A	FELL	
CLP 132kV	Section 6 - T133	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	114	4	5	*	N/A	FELL	
CLP 132kV	Section 6 - T134	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	155	4	6	*	N/A	FELL	
CLP 132kV	Section 6 - T135	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	296	7	6	*	N/A	FELL	
CLP 132kV	Section 6 - T136	CLP 132kV	N/A	N/A	苦楝	Melia azedarach	187	6	6	*	N/A	RETAIN	
CLP 132kV	Section 6 - T137	CLP 132kV	N/A	N/A	潺槁	Litsea glutinosa	362	4.5	3.5	*	N/A	FELL	
CLP 132kV	Section 6 - T138	CLP 132kV	N/A	N/A	黃槿	Hibiscus tiliaceus	127	6.5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T139	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	258	7	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T140	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	241	5	6.5	*	N/A	FELL	
CLP 132kV	Section 6 - T141	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	193	3	6	*	N/A	FELL	
CLP 132kV	Section 6 - T142	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	167	4	7	*	N/A	FELL	
CLP 132kV	Section 6 - T143	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	268	4.5	7	*	N/A	FELL	
CLP 132kV	Section 6 - T144	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	203	6	7	*	N/A	FELL	
CLP 132kV	Section 6 - T145	CLP 132kV	N/A	N/A	台灣相思	Acacia confusa Merr	133	3	6.5	*	N/A	FELL	
(*) : Not provided in LVP							Total		Retain	320	24	66	
N/A for status : Not yet received by contractor in the reporting period									Transplant	36	26	26	
REMOVED for status: Tree felling due to typhoon or works not related to this Project									To-be-felled	0	0	0	
Green colour for cells: Changed of tree status during the period from end 2024 to end 2025									Fell	2218	2338	2672	
									NA	0	0	0	

