China Harbour Engineering Company Limited

Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works – Stage V Phase II B

Monthly Environmental Monitoring and Audit Report for August 2010

(Version 1.1)

Certified By

(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties.

CINOTECH CONSULTANTS LTD

Room 1710, Technology Park, 18 On Lai Street, Shatin, NT, Hong Kong Tel: (852) 2151 2083 Fax: (852) 3107 1388 Email: info@cinotech.com.hk

TABLE OF CONTENTS

	Pa Pa	ıge
EX	ECUTIVE SUMMARY	. 1
Env Env Key	oduction rironmental Monitoring and Audit Works rironmental Licenses and Permits Information in the Reporting Month ure Key Issues	. 1
1	INTRODUCTION	3
Bac	kground	. 3
	nstruction Programme	
Sun	nmary of EM&A Requirements	
2	AIR QUALITY MONITORING	. 6
	nitoring Requirements	
	nitoring Locations	
	nitoring Equipment	
	nitoring Parameters, Frequency and Duration	
	ults and Observations	
3	NOISE MONITORING	10
	nitoring Requirements	
	nitoring Locations	
	nitoring Equipment	
Mo	nitoring Parameters, Frequency and Duration	10
	nitoring Methodology and QA/QC Procedures	
Res	ults and Observations	12
4	LANDFILL GAS MONITORING	13
Mo	nitoring Requirements	13
	nitoring Locations	
	nitoring Equipment	
	ults	
5	ENVIRONMENTAL AUDIT	
	Audits	
	view of Environmental Monitoring Procedures	
	tus of Environmental Licensing and Permitting	
	lementation Status of Environmental Mitigation Measures	
_	nmary of Exceedances.	
	elementation Status of Event Action Plans	
_	nmary of Complaint and Prosecution	
6	FUTURE KEY ISSUES	18
Mo	nitoring Schedule for the Next Month	18
	nstruction Program for the Next Month	
7	CONCLUSIONS AND RECOMMENDATIONS	19

Conclusions	
Recommenda	tions
LIST OF TA	BLES
Table I	Summary Table for Events Recorded in the Reporting Month
Table II	Summary Table for Key Information in the Reporting Month
Table 1.1	Key Project Contacts
Table 2.1	Locations for Air Quality Monitoring
Table 2.2	Air Quality Monitoring Equipment
Table 2.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 2.4	Summary Table of Air Quality Monitoring Results during the reporting month
Table 3.1	Location of Noise Monitoring Station
Table 3.2	Noise Monitoring Equipment
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 3.4	Summary Table of Noise Monitoring Results during the Reporting Month
Table 4.1 Table 5.1	Landfill Gas Monitoring Equipment Summary of Environmental Licensing and Permit Status
Table 5.1 Table 5.2	Observations and Recommendations of Site Audit
1 autc 3.2	Observations and Recommendations of Site Addit
LIST OF FIG	GURE
Figure 1.1	Site Layout Plan
Figure 1.2	Locations of Air Quality and Noise Monitoring Stations
Figure 1.3	Landfill Gas Monitoring Area
LIST OF AP	PENDICES
Appendix A	Action and Limit Levels
Appendix B	Copies of Calibration Certificates
Appendix C	Environmental Monitoring Schedules
Appendix D	1-hour TSP Monitoring Results and Graphical Presentations
Appendix E	24-hour TSP Monitoring Results and Graphical Presentations
Appendix F	Noise Monitoring Results and Graphical Presentations
Appendix G	Records of Landfill Gas Measurement by the Contractor
Appendix H	Summary of Exceedance
Appendix I	Site Audit Summary
Appendix J	Event Action Plans
Appendix K	Updated Environmental Mitigation Implementation Schedule
Appendix L	Waste Generation in the Reporting Month
Appendix M	Complaint Log
Appendix N	Construction Programme

EXECUTIVE SUMMARY

Introduction

- 1. This is the 2nd monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for DSD Contract no. DC/2009/09 "Construction of Tai Po Sewage Treatment Works Stage V Phase IIB". This report documents the findings of EM&A Works conducted in August 2010.
- 2. The major site activities undertaken in the reporting month included:
 - Confined Space Works;
 - Dismantling works;
 - Drainage and Excavation works;
 - Landscaping works;
 - Mini-piling works;
 - Pre-drilling works;
 - Pre-bored socketted H-pilings; and
 - · Pipeline works

Environmental Monitoring and Audit Works

- 3. Environmental monitoring and audit works for the Project were performed regularly as stipulated in the Final EM&A Manual and the results were checked and reviewed. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
- 4. Summary of the events and action taken in the reporting month is tabulated in **Table I**.

Table I Summary Table for Events Recorded in the Reporting Month

Donomoton	No. of Ex	ceedance	No. of Events	Astion Tokon
Parameter	Action Level	Limit Level	Due to this Project	Action Taken
1-hr TSP	0	0	0	N/A
24-hr TSP	0	0	0	N/A
Noise	0	0	0	N/A

5. In the reporting month, excavation works were undertaken within the 250m Consultation Zone of Shuen Wan Landfill. Landfill gas monitoring was performed by the Safety Officer of the Contractor. All the measured results were complied with the Limit Levels.

Environmental Licenses and Permits

6. Environmental related licenses/permits granted to the Project include the Environmental Permit (EP) for the Project, the Discharge Licence, Construction Noise Permit and the Waste Disposal (Chemical Waste) Licence.

Key Information in the Reporting Month

7. Summary of key information in this reporting month is tabulated in Table II.

Table II Summary Table for Key Information in the Reporting Month

Event	Ev	ent Details	Action Taken	Status	Remark	
Event	Number	Nature	Action Taken	Status	Kemark	
Complaint received	0		N/A	N/A		
Changes to the assumptions and key construction / operation activities recorded	0		N/A	N/A		
Status of submissions under EP	1	Monthly EM&A Report (July 10)	Submitted to EPD on 13 th August 2010 (EP condition 6.6).	No comment		
Notifications of any summons & prosecutions	0		N/A	N/A		

Future Key Issues

- 8. Major site activities for the coming two months will include:
 - Confined Space Works
 - Structure works;
 - Dismantling works;
 - Drainage and Excavation works;
 - Landscaping works;
 - Mini-piling works;
 - Pre-drilling works;
 - Pre-bored socketted H-pilings; and
 - Pipeline works
- 9. The future environmental concerns are air quality, noise impacts, waste management and surface runoff from construction works.

1 INTRODUCTION


Background

- 1.1 Tai Po Sewage Treatment Works (TPSTW) is located within the Tai Po Industrial Estate. It currently comprises four Stages: I, II, IVA and IVB works. The TPSTW Stage V aims to upgrade the existing STW to provide additional sewage treatment capacity from the present design flow of 88,000 m³/day to 130,000 m³/day to meet the demands of both the existing and future developments, and to meet the revised discharge license requirements.
- 1.2 The TPSTW Stage V, Phase I and Phase II are Designated Projects under the Environmental Impact Assessment Ordinance (Cap. 449) with the same EIAO Register No. AEIAR 081/2004. A study of environmental impact assessment (EIA) was undertaken to evaluate various environmental impacts associated with the works within these two Designed Projects. An EIA Report as well as an Environmental Monitoring and Audit (EM&A) Manual were approved by the Environmental Protection Department (EPD) on 28 October 2004.
- 1.3 The Stage V works will be implemented in 2 phases. The design capacities of Phase I and Phase II works are 100,000 m³/d and 130,000 m³/d respectively. An Environmental Permit (EP) No. EP-265/2007 was issued on 22 March 2007 for the TPSTW Stage V Phase II to the Drainage Services Department (DSD) as the Permit Holder. The project "Tai Po Sewage Treatment Works Stage V Phase IIB" formed part of the Phase II works, includes additional secondary treatment process units (1 primary clarifier; 3 bioreactors and 2 final clarifiers) in TPSTW for its future extended plant design capacity of 120,000 m³/day. A master construction programme of the Project is provided in **Appendix N**. A site layout plan is provided in **Figure 1.1**. The construction activities of the Project commenced on 3 July 2010.
- 1.4 Cinotech Consultants Ltd. was commissioned by the Contractor as the Environmental Team (ET) to undertake the EM&A works for the Project. Dr. Priscilla CHOY of Cinotech Consultants Ltd. was appointed as the ET Leader as per the Condition 2.1 of the EP. Ove Arup and Partners Hong Kong Limited. was appointed as the IEC under Condition 2.2 of the EP. This is the 2nd monthly EM&A report summarizing the EM&A works for the Project in August 2010.

Project Organizations

- 1.5 Different parties with different levels of involvement in the project organization include:
 - Project Proponent / Engineer's Representative (ER) Drainage Services Department
 - Environmental Team (ET) Cinotech Consultants Ltd.
 - Independent Environmental Checker (IEC) Ove Arup and Partners Hong Kong Limited
 - Contractor China Harbour Engineering Company Ltd.
- 1.6 The responsibilities of respective parties are detailed in Section 1.10 of the Final EM&A Manual of the Project.

1.7 The Project Organization during Construction Phase

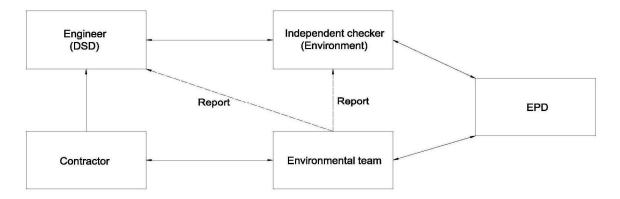

1.8 The key contacts of the Project are shown in **Table 1.1**.

Table 1.1 Key Project Contacts

Party	Role	Name	Position	Phone No.	Fax No.
		Mr. LAI cheuk-ho	Chief Engineer	2594 7500	
DSD	SP Division	Mr. IP Shu-kuen	Senior Engineer	2594 7502	2827 8700
		Mr. TSANG Lap-kei	Engineer	2594 7459	
		Dr. Priscilla CHOY	ET Leader	2151 2089	
Cinotech	Environmental Team	Mr. Sam LAM	Project Coordinator and Audit Team Leader	2151 2077	3107 1388
		Mr. Henry LEUNG	Monitoring Team Leader	2151 2087	
A	Independent Environmental	Mr. Coleman NG	Independent Environmental Checker	2268 3097	2528 3031
Arup	Checker	Mr. Cyrus LEUNG	Assistant to Independent Environmental Checker	2268 3456	2328 3031
		Mr. TK CHEUNG	Project Manager	9863 2954	
CHEC	Civil Contractor	Mr. Aaron AU	Site Agent	6345 0754	2603 6899
		Mr. Jason TSE	Environmental Offiecr	9320 3608	

Construction Programme

- 1.9 The site activities undertaken in the reporting month were:
 - Confined Space Works;
 - Dismantling works;
 - Drainage and Excavation works;
 - Landscaping works;
 - Mini-piling works;
 - Pre-drilling works;
 - Pre-bored socketted H-pilings; and
 - · Pipeline works

Summary of EM&A Requirements

1.10 The EM&A programme requires construction phase air quality and noise monitoring as well as environmental site audits. The EM&A requirements are described in the

following sections, including:

- All monitoring parameters;
- Action and Limit levels for all environmental parameters;
- Event / Action Plans;
- Environmental mitigation measures, as recommended in the project EIA study final report; and
- Environmental requirements in contract documents.
- 1.11 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 5 of this report.
- 1.12 This report presents the monitoring results, observations, locations, equipment, period, methodology and QA/QC procedures of the required monitoring parameters, namely air quality and noise as well as audit works for the Project in the reporting month.

2 AIR QUALITY MONITORING

Monitoring Requirements

- 2.1 Monitoring of 1-hour and 24-hour Total Suspended Particulates (TSP) was conducted to monitor the air quality during construction phase. **Appendix A** shows the established Action/Limit Levels for the environmental monitoring works.
- 2.2 In accordance with Section 2.30 of the EM&A Manual, a baseline checking of ambient TSP levels shall be carried out every six months at each monitoring station, when no dusty works activities are in operation. The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.

Monitoring Locations

2.3 Impact air quality monitoring was conducted at the 3 monitoring stations, as shown in **Figure 1.2**. **Table 2.1** describes the locations of the air quality monitoring stations.

Table 2.1 Locations for Air Quality Monitoring

Monitoring Stations	Description	Location of Measurement	
CAM1	Government Staff Quarters	Rooftop	
CAM2	Hung Hing Printing Centre	On the site boundary just next to the Hung Hing Printing Centre	
CAM3	Talcon Industrial Ltd.	On the site boundary just next to Talcon Industrial Ltd.	

Monitoring Equipment

2.4 **Table 2.2** summarizes the equipment used for the air quality monitoring.

Table 2.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Qty.
HVS	Graseby GMW 2310 HVS, Model GS-2310105-1, Serial no. 10239 and 0810	2
нүз	Tisch Environmental, Inc.; Model no. TE-5170, Serial no. 1704	1
Calibrator	Tisch Environmental, Inc.; Model no. TE-5028 ^a Serial no. 9833620	1

Monitoring Parameters, Frequency and Duration

2.5 **Table 2.3** summarizes the monitoring parameters and frequencies of impact dust monitoring for the whole construction period.

 Table 2.3
 Impact Dust Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Duration	Period	Frequency
CAM1, CAM2 and	1-hour TSP	1 hour	During daytime period	3 times / 6-day
CAM3	24-hour TSP	24 hours	24 hours	Once / 6-day

Monitoring Methodology and QA/QC Procedure

Instrumentation

2.6 High Volume Samplers (HVS) connected with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

HVS Installation

- 2.7 The following guidelines were adopted during the installation of HVS:
 - Sufficient support was provided to secure the samplers against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.
 - The samplers were more than 20 meters from the drip line.
 - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.

Filters Preparation

- 2.8 Fiberglass filters (G810) were used [Note: these filters have a collection efficiency of larger than 99% for particles of 0.3 mm diameter]. A HOKLAS accredited laboratory, Wellab Ltd., was responsible for the preparation of pre-weighed filter papers for Cinotech's monitoring team.
- 2.9 All filters, which were prepared by Wellab Ltd., were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ±3 °C; the relative humidity (RH) was <50% and not variable by more than ±5%. A convenient working RH was 40%.
- 2.10 Wellab Ltd. has a comprehensive quality assurance and quality control programmes.

Operating/Analytical Procedures

- 2.11 Operating/analytical procedures for the TSP monitoring were highlighted as follows:
 - Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard.
 - The power supply was checked to ensure the sampler worked properly.
 - On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the air quality monitoring station.
 - The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
 - The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts to avoid air leakage at the edges.
 - The shelter lid was closed and secured with the aluminum strip.
 - The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
 - The flow rate of the HVS sampler would be verified to be constant and recorded on the data sheet after sampling.
 - After sampling, the filter was removed and sent to the Wellab Ltd. for weighing. The elapsed time was also recorded.
 - Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment should be between 25°C and 30°C and not vary by more than ±3°C; the relative humidity (RH) should be < 50% and not vary by more than ±5%. A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

Maintenance/Calibration

- 2.12 The following maintenance/calibration was required for the HVS:
 - The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
 - Calibration of the HVS (five point calibration) using Calibration Kit was carried out every two months. Copies of calibration certificates are attached in **Appendix B**.
 - The HVS calibration orifice will be calibrated annually.

Results and Observations

- 2.13 In the reporting month, 1-hr TSP monitoring was carried out as schedule at each designated monitoring station on 13 occasions. 24-hr TSP monitoring was carried out as scheduled at each designated monitoring station on 5 occasions. The monitoring schedule was updated and is shown in **Appendix C**. The weather during the monitoring sessions was mainly sunny and cloudy.
- 2.14 All measured 1-hr and 24-hr TSP levels were below the Action/Limit Levels. No exceedance was recorded in the reporting month.

2.15 The monitoring data and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices D** and **E**, respectively.

Table 2.4 Summary Table of Air Quality Monitoring Results during the reporting month

Parameter	Minimum μg/m³	Maximum μg/m³	Average μg/m³	Action Level, μg/m³	Limit Level, µg/m³	
1-hr TSP (CAM1)	32	148	75	315	500	
24-hr TSP (CAM1)	14	59	35	171	260	
1-hr TSP (CAM2)	71	173	110	336	500	
24-hr TSP (CAM2)	26	92	49	177	260	
1-hr TSP (CAM3)	50	201	130	344	500	
24-hr TSP (CAM3)	35	103	65	192	260	

2.16 According to our field observations, the major dust source identified at the designated air quality monitoring stations are as follows:

Station	Major Pollution Source
CAM1 – Government Staff Quarters	Road Traffic Dust
CAM2 – Hung Hing Printing Centre	Road Traffic Dust and Excavation
CAM3 – Talcon Industrial Ltd.	Road Traffic Dust and Excavation

3 NOISE MONITORING

Monitoring Requirements

- 3.1 Noise monitoring was conducted in accordance with the EM&A Manual. **Appendix A** shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.

Monitoring Locations

3.3 Noise monitoring was conducted at one designated monitoring station as presented in **Table 3.1**. **Figure 1.2** shows the locations of the monitoring station.

Table 3.1 Location of Noise Monitoring Station

Monitoring Station Description		Location of Measurement
NM1	Government Staff Quarters	The corridor at the first floor.

Monitoring Equipment

3.4 **Table 3.2** summarizes the noise monitoring equipment model being used.

Table 3.2 Noise Monitoring Equipment

Equipment	Model and Make	Quantity
Integrating Sound Level Meter	SVAN 955 (Serial No.14302 and 14303)	2
Calibrator	B&K 4231 (Serial No. 2326353 and SV30A (Serial No.10965)	2
Wind Speed Anemometer	Vane Anemometer, Model 451104 (Serial no. 9020746)	1

Monitoring Parameters, Frequency and Duration

3.5 **Table 3.3** summarizes the monitoring parameters, frequency and total duration of monitoring.

Table 3.3 Noise Monitoring Parameters, Frequency and Duration

Station	Parameter	Period	Frequency
NM1	$L_{eq}(30 \text{ min.})$ (L_{10} and L_{90} were also recorded as supplementary information)	0700-1900 hrs. on normal weekdays	Once a week

3.6 If construction works are extended to include works during the hours of 1900 - 0700, additional weekly impact monitoring would be carried out during evening and night-time works. Applicable permits under NCO have been obtained by the Contractor. The

details of the Construction Noise Permit can be referred to **Table 5.1**.

3.7 Monitoring Methodology and QA/QC Procedures

Field Monitoring

- 3.8 The monitoring procedures are as follows:
 - The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
 - The battery condition was checked to ensure good functioning of the meter.
 - Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:

frequency weighting : Atime weighting : Fast

- measurement time : 30 minutes

- Prior to and after noise measurement, the meter was calibrated using the calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement is more than 1.0 dB, the measurement was considered invalid and repeat of noise measurement was required after re-calibration or repair of the equipment.
- The wind speed at the monitoring station was checked with the portable wind meter.
 Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.
- Noise measurement was paused during periods of high intrusive noise if possible and observation was recorded when intrusive noise was not avoided.
- At the end of the monitoring period, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.

Maintenance and Calibration

- 3.9 Maintenance and Calibration procedures were as follows:
 - The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
 - The sound level meter and calibrator were checked and calibrated at yearly intervals. Copies of calibration certificates are attached in **Appendix B**.

Results and Observations

- 3.10 In the reporting month, noise monitoring during non-restricted hours was conducted as scheduled at the designated location on 4 occasions. As advised by the Contractor, no construction activities will be undertaken during restricted hours as such noise monitoring during restricted hours was omitted. The noise monitoring schedule is provided in **Appendix C**.
- 3.11 The details of the monitoring results and graphical presentations are shown in **Appendix F**. The weather during the monitoring sessions was mainly sunny and fine.
- 3.12 No Action/Limit Level exceedance for construction noise monitoring was recorded in the reporting month.

Table 3.4 Summary Table of Noise Monitoring Results during the Reporting Month

Parameter	Minimum Leq(30min) dB(A)	Maximum Leq(30min) dB(A)	Average Leq(30min) dB (A)	Action Level	Limit Level,
NM1	63.8	68.1	67.0	When one documented complaint is received	75dB(A)

3.13 According to our field observations, the major noise source identified at the designated air quality monitoring stations are as follows:

Station	Major Noise Source
NM1 – Government Staff Quarters	Road Traffic Construction of Main Site

4 LANDFILL GAS MONITORING

Monitoring Requirements

4.1 In accordance with Section 6 of the EM&A Manual, monitoring of landfill gas is required for construction works within the 250m Consultation Zone of Shuen Wan Landfill (the Consultation Zone). This Section reports the results of landfill gas measurements performed by the Safety Officer of the Contractor. **Appendix A** shows the Limit Levels for the monitoring works.

Monitoring Parameters and Frequency

- 4.2 The parameters for Landfill gas monitoring include Percentage of Combustible Gas (Methane), Carbon dioxide and Oxygen.
- 4.3 The Landfill gas monitoring is carried out before the entry of concern zone by the Contractor in the morning and afternoon.

Monitoring Locations

- 4.4 Monitoring of oxygen, methane and carbon dioxide was performed for excavations at 1m depth or more within the Consultation Zone. In this reporting month, the area required to be monitored for landfill gas are shown below and **Figure 1.3** shows the landfill gas monitoring locations.
 - FC11B and FC12B
 - Pipe 600 Excavation Trench
 - Pipe 900 Excavation Trench
 - Pipe 300 Excavation Trench

Monitoring Equipment

4.5 **Table 4.1** summarizes the equipment employed by the Contractor for the landfill gas monitoring.

Table 4.1 Landfill Gas Monitoring Equipment

Equipment	Model and Make	Quantity
Intrinsically safe, portable gas detector	Crowcon Custodian CDL Portable Gas Detector	1

Results

4.6 In the reporting month, landfill gas monitoring was carried out by the Contractor at the aforesaid locations on total 188 occasions. The monitoring results are provided in **Appendix G**. Copies of calibration certificates are attached in **Appendix B**.

5 ENVIRONMENTAL AUDIT

Site Audits

- 5.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Project site. The summaries of site audits are attached in **Appendix H**.
- 5.2 Site audits were conducted on 6th, 13th, 19th and 26th August 2010 by ET. A joint site audit with the representative with IEC, ER, the Contractor and the ET was carried out on 6th August 2010. No site inspection was conducted by EPD during the reporting month. The details of observations during site audit can refer to **Table 5.2**.

Review of Environmental Monitoring Procedures

5.3 The monitoring works conducted by the monitoring team were inspected regularly. The following observations have been recorded for the monitoring works:

Air Quality Monitoring

- The monitoring team recorded all observations around the monitoring stations within and outside the construction site.
- The monitoring team recorded the temperature and weather conditions on the monitoring days.

Noise Monitoring

- The monitoring team recorded all observations around the monitoring stations, which might affect the monitoring result.
- Major noise sources were identified and recorded. Other intrusive noise attributing to the result was trimmed off by pausing the monitoring temporarily.

Landfill Gas Monitoring

• The Contractor has checked the condition of the equipment before monitoring to ensure the reliability.

Status of Environmental Licensing and Permitting

5.4 All permits/licenses obtained for the Project are summarized in **Table 5.1**.

 Table 5.1
 Summary of Environmental Licensing and Permit Status

Permit / License No.	Valid Period		Details	Status	
Permit / License No.	From	To	Details	Status	
Environmental Permit (EP)					
EP-265/2007	22/3/2007	N/A	Expansion and upgrading of existing Tai Po Sewage Treatment Works from 100,000 m³/day to 130,000 m³/day: (a) additional secondary treatment process units(1 primary clarified; 3 bioreactors and 2 final clarifiers); (b) reconstruction of 4 existing final clarified; (c) provision of ultraviolet disinfection facilities; (d) additional sludge treatment facilities; and (e) ancillary works to existing treatment facilities.	Valid	
Consruction Noise Per	rmit (CNP)	I .			
GW-RN0137-10	17/5/2010	16/11/2010	Use of powered mechanical equipment for carrying out construction work at 7 Dai Kwai Street, Tai Po Industrial Estate, Tai Po, N.T. during 0000 – 2400 hours on general holidays (including Sundays), 0000 – 0700 hours and 1900 – 2400 hours on any day not being a general holiday.	Vaild	
Discharge Licence	24/05/10	21/05/15	I 5: 1	** 11 1	
3330	24/05/10	31/05/15	Discharge of industrial trade effluent: Water Control Zone: Tolo Harbour and Channel Discharge Points: Communal drain for the carriage of surface drainage water	Valid	
Waste Disposal (Chen					
WPN: 5213-727-C2397-16	09/07/10	End of Project	Disposal of Chemical Waste including spent oil, lubricating oil, diesel oil and methanol, surplus paint, thinner	Valid	

Status of Waste Management

5.5 The Construction and Demolition (C&D) materials generated in the reporting month were mainly inert C&D waste and C&D waste. The quantities of waste generated in this reporting month are summarized in **Appendix L**. No chemical waste was generated in the reporting month.

Implementation Status of Environmental Mitigation Measures

- 5.6 According to the EIA Study Report, Environmental Permit and the EM&A Manual of the Project, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix K**.
- 5.7 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 5.2**.

Table 5.2 Observations and Recommendations of Site Audit

Parameters	Date	Observations and Recommendations	Follow-up
	6-August-2010	Silty water was observed from the outflow of the sedimentation tank at FC11B and FC12B. The contractor was reminded to improve the sediment process.	The situation required follow-up action during the coming audit session 100813.
	6-August-2010	Silt was observed in the U-channel near the office at TPSTW. The contractor was reminded to clear it.	The situation was observed rectified in audit session 100813.
	6-August-2010	Improve the bunds near the U-channel near the office at TPSTW.	The situation was observed rectified in audit session 100813.
	6-August-2010	Stagnant water was observed inside the drip tray near TPSTW site office. The contractor was reminded to treat it as chemical waste and clear it.	The situation was observed rectified in audit session 100813.
Water	6-August-2010	Stagnant water was observed near the TPSTW site office. The contractor was reminded to clear it.	The situation was observed rectified in audit session 100813.
Quality	6-August-2010	Direct discharge was observed at 600 pipe. The contractor was reminded to provide proper treatment before discharge.	The situation was observed rectified in audit session 100813.
	6-August-2010	Stagnant water was observed near A-Tank. The contractor was reminded to clear it.	The situation was observed rectified in audit session 100813.
	13-August-2010	Stagnant water was observed in the drip tray of the pumping equipment near A-Tank. The contractor was reminded to clear it and treat as chemical water.	The situation required follow-up action during the coming audit session 100819.
	13-August-2010	Silty water was observed from the outflow of the sedimentation tank at FC11B and FC12B. The contractor was reminded to improve the sediment process.	The situation was observed rectified in audit session 100819.
	19-August-2010	Stagnant water was observed in the drip tray of the pumping equipment near A-Tank. The contractor was reminded to clean it.	The situation was observed rectified in audit session 100826.

	26-August-2010	Silt was observed in the U-channel at 600 pipe. The contractor was reminded to clear it.	The situation required follow-up action during the coming audit session.
Air Quality	19-August-2010	Open Stockpile was observed in Between M1 and M2. The contractor was reminded to cover it properly.	The situation was observed rectified in audit session 100826.
	6-August-2010	Larger drip tray is required near the TPSTW. Site office. The contractor was reminded to provide a drip tray 1.1 times larger than oil drum.	The situation was observed rectified in audit session 100813.
Waste	13-August-2010	General refuse was observed at the entrance of the construction area near A-Tank. The contractor was reminded to clear it.	The situation was observed rectified in audit session 100819.
/Chemical Management	19-August-2010	The drip tray at the pumping equipment near A-Tank was observed without maintain properly (broken bottom). The contractor was reminded to repair it.	The situation was observed rectified in audit session 100826.
	26-August-2010	Oil drum was observed standing on the ground at FC11B and FC12B area. The contractor was reminded to provide drip tray and proper label.	The situation required follow-up action during the coming audit session.
Other	26-August-2010	The contractor was reminded to repair the fencing of the tree protection zone at FC11B and FC12B area.	The situation required follow-up action during the coming audit session.

Summary of Exceedances

5.8 No exceedance of monitoring results was recorded in the reporting month. Summary of exceedance is provided in **Appendix H**.

Implementation Status of Event Action Plans

5.9 The Event Action Plans for air quality, construction noise and landfill gas monitoring are presented in **Appendix J**. No exceedance was recorded and thus no action was required to be implemented.

Summary of Complaint and Prosecution

- 5.10 No environmental related complaint, prosecution or notification of summons was received in the reporting month.
- 5.11 There was no environmental complaint, prosecution or notification of summons received since the Project commencement. The Complaint Log is attached in **Appendix M**.

6 FUTURE KEY ISSUES

- 6.1 Key issues to be considered in the coming month include:
 - Effluent discharge generated from surface runoff;
 - Dust generated from excavation works, backfilling works and stockpile of dusty materials;
 - Maintenance of de-silting facilities and drainage system, such as U-channels;
 - Accumulation of stagnant water in the site areas; and
 - Accumulation of C&D waste and general waste on site.

Monitoring Schedule for the Next Month

6.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix C**.

Construction Program for the Next Month

- 6.3 A tentative construction programme is provided in **Appendix N**. The major construction activities in the coming month will include:
 - Confined Space Works
 - Structure works;
 - Dismantling works;
 - Drainage and Excavation works;
 - Landscaping works;
 - Mini-piling works;
 - Pre-drilling works;
 - Pre-bored socketted H-pilings; and
 - Pipeline works

7 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

- 7.1 Environmental monitoring and audit works were conducted in the reporting month. Site inspections were conducted on a weekly basis. The results were reviewed and checked.
- 7.2 No exceedance of monitoring results was recorded in the reporting month.
- 7.3 There was no environmental complaint, prosecution or notification of summons received.

Recommendations

7.4 According to the environmental audit performed in the reporting month, the following recommendations were made:

Water Impact

- To provide sediment tank for settling runoff prior to disposal.
- To ensure proper use and maintenance of the de-silting facilities.
- To avoid accumulation of stagnant water on site.
- To maintain sand bags placed along the u-channel at good condition and replace the broken bags.
- To avoid blockage of gully inlets and ensure proper protection of the gully from ingress of sandy water.

Dust Impact

- To remove fugitive dusty material on the haul road periodically.
- To spray with water on the surface of concrete breaking and dry dust haul road.
- Excavated dusty materials or stockpile of dusty materials should be covered by impervious sheeting, or sprayed with water so as to maintain entire surface wet.


Noise Impact


 To space out noisy equipment and position as far away as possible from sensitive receivers.


Waste / Chemical Management

- To provide proper rubbish bins / skips for waste collection.
- To provide proper storage area for oil container on site.
- To avoid and check for any accumulation of waste materials or rubbish on site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the equipment.
- Provide drip tray with adequate capacity and maintain well for equipment and chemical waste.

FIGURES

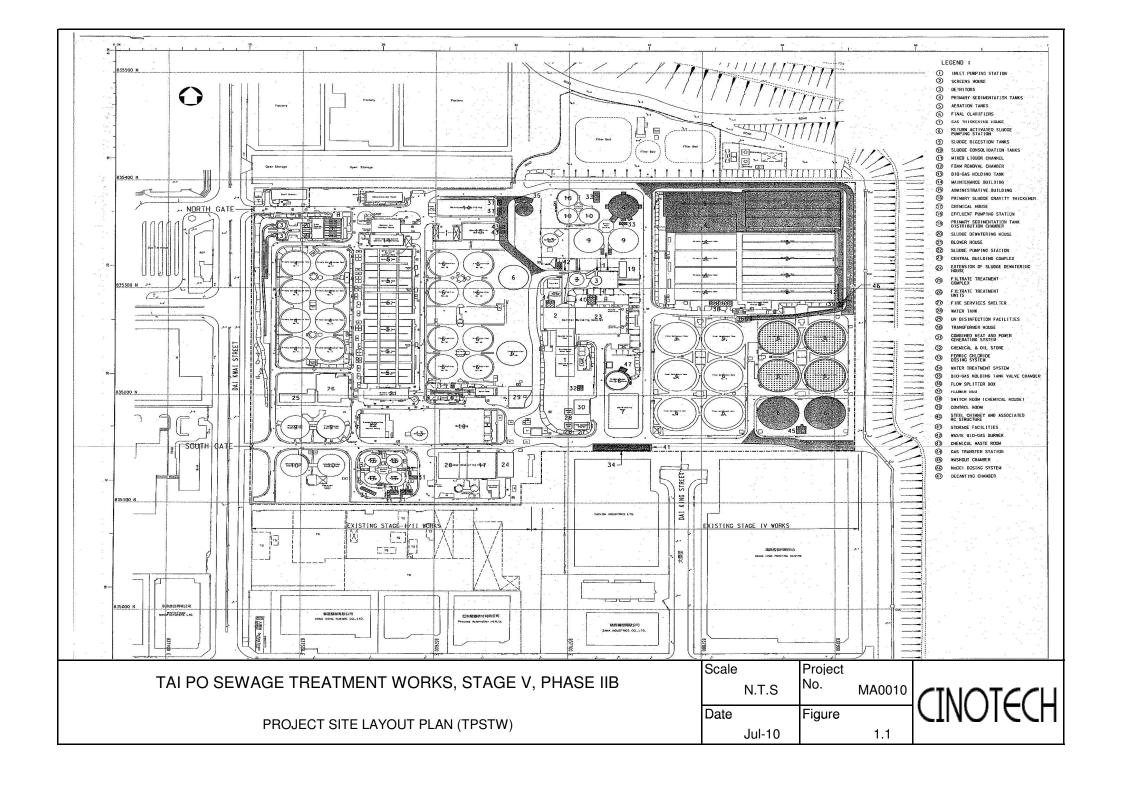

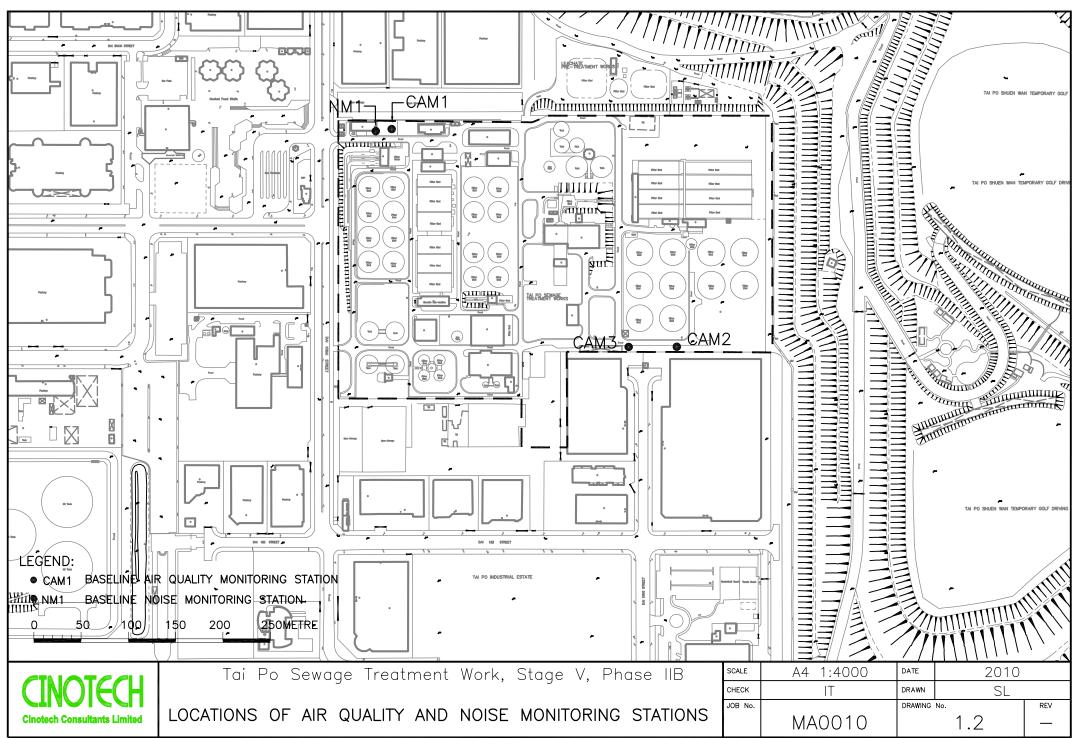

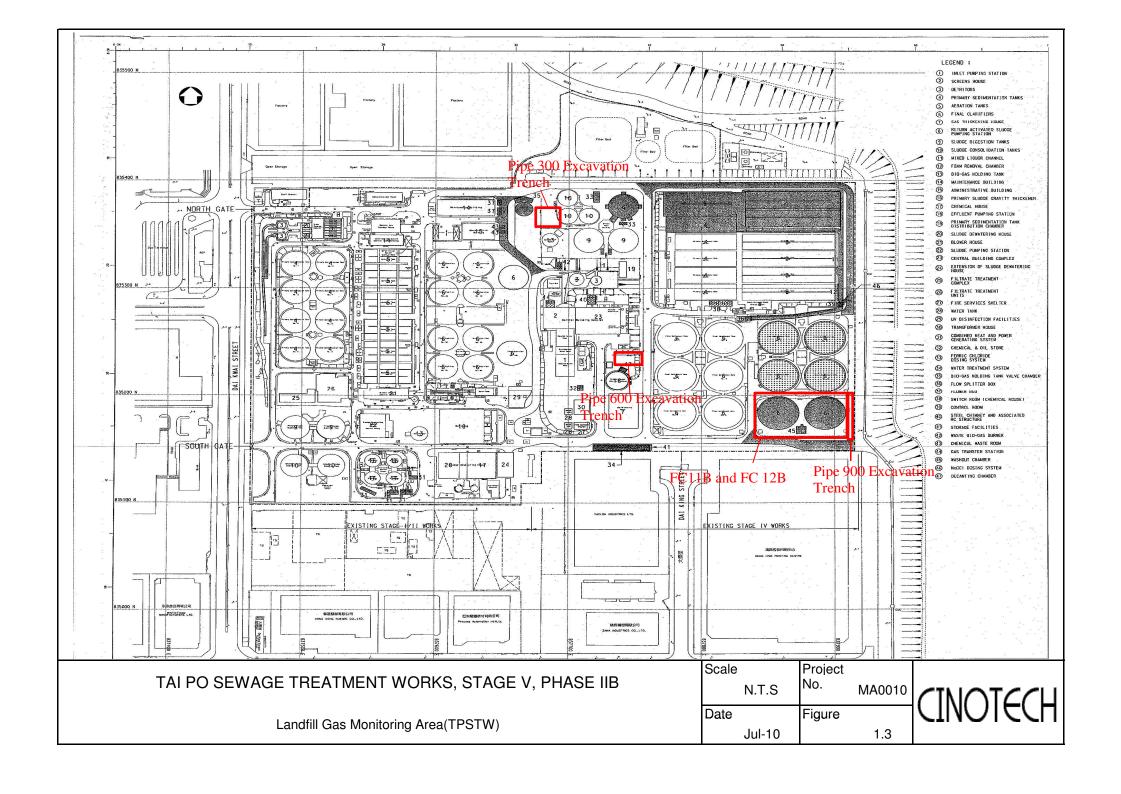

APPENDIX A ACTION AND LIMIT LEVELS

APPENDIX A – Action and Limit Levels

1-Hour TSP

Location	Action Level, μg/m ³	Limit Level, μg/m ³
CAM1	315	
CAM2	336	500
CAM3	344	

24-Hour TSP

Location	Action Level, μg/m ³	Limit Level, μg/m ³
CAM1	171	
CAM2	177	260
CAM3	192	

Construction Noise

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays		75 dB(A)
0700-2300 hrs on holidays; and 1900-2300 hrs on all other days	When one documented complaint is received	70* dB(A)
2300-0700 hrs of next day		55* dB(A)

Notes:

^{*} The Area Sensitivity Rating for Station NM1 is taken as C, due to the nearby industrial area, according to Table 1 of EPD's Technical Memorandum on Noise from Construction Work other than Percussive Piling.

Landfill Gas

Parameter	Limit Level	Action
	<19%	Ventilate to restore oxygen to >19%
Oxygen	<18%	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore oxygen to >19%
Methane	>10% LEL (i.e. >0.5% by volume)	Post "No Smoking" signs Prohibit hot works Ventilate to restore methane to <10% LEL
	>20% LEL (i.e. >1% by volume)	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore methane to <10%
	>0.5%	Ventilate to restore carbon dioxide to <0.5%
Carbon Dioxide	>1.5%	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore carbon dioxide to <0.5%

APPENDIX B COPIES OF CALIBRATION CERTIFCATES

CINOTECH

File No. <u>MA5023/37/0032</u> Station CAM1 - Government Staff Quarter Operator: CH Date: 7-Jun-10 Next Due Date: 6-Aug-10 Serial No. 1704 Equipment No.: A-01-37 **Ambient Condition** 760.6 299.7 Temperature, Ta (K) Pressure, Pa (mmHg) Orifice Transfer Standard Information 0.0448 Intercept, be 0.0086 A-04-06 Equipment No.: Slope, mc mc x Qstd + bc = $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ 4-Nov-09 Last Calibration Date: Qstd = $\{ [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} -bc \} / mc$ Next Calibration Date: 3-Nov-10 Calibration of TSP Sampler Orfice HVS Calibration Qstd (CFM) $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2} \text{ Y-}$ ΔH (orifice), ΔW [ΔH x (Pa/760) x (298/Ta)]^{1/2} **Point** in. of water X - axis (HVS), in. of oil axis 74.33 7.9 11.2 3.34 2.80 9.9 69.87 6.6 2.56 2 3.14 3 7.5 2.73 60.79 5.1 2.25 5.0 2.23 49.60 3.3 1.81 4 1.81 40.26 2.0 1.41 5 3.3 By Linear Regression of Y on X Slope, $mw = \underline{0.0399}$ Intercept, bw :______ -0.1821 Correlation coefficient* = 0.9989 *If Correlation Coefficient < 0.990, check and recalibrate. Set Point Calculation From the TSP Field Calibration Curve, take Qstd = 43 CFM From the Regression Equation, the "Y" value according to mw x Qstd + bw = $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ Remarks: Conducted by: Date: Checked by: Signature: Date:



File No. MA0010/37/0033 Station CAM1 - Government Staff Quarter Operator: CH Date: 5-Aug-10 Next Due Date: 4-Oct-10 Equipment No.: A-01-37 Serial No. _____ 1704 **Ambient Condition** Temperature, Ta (K) 303.3 Pressure, Pa (mmHg) 756.4 Orifice Transfer Standard Information Equipment No.: A-04-06 Slope, mc 0.0448 Intercept, be Last Calibration Date: 4-Nov-09 mc x Qstd + bc = $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ Qstd = $\{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} -bc\} / mc$ **Next Calibration Date:** 3-Nov-10 Calibration of TSP Sampler Orfice Calibration ΔH (orifice), $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2} \text{ Y-}$ Ostd (CFM) ΔW Point $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ in. of water X - axis (HVS), in. of oil 11.6 74.99 3.37 7.9 2.78 2 9.7 3.08 6.5 2.52 68.55 3 7.6 2.73 60.66 5.1 2.23 4 5.0 2.21 49.16 3.2 1.77 3.2 39.29 1.77 1.9 1.36 By Linear Regression of Y on X Slope , mw = ______0.0395 Intercept, bw: -0.1814 Correlation coefficient* = 0.9998 *If Correlation Coefficient < 0.990, check and recalibrate. **Set Point Calculation** From the TSP Field Calibration Curve, take Qstd = 43 CFM From the Regression Equation, the "Y" value according to mw x Qstd + bw = $[\Delta W \times (Pa/760) \times (298/\Gamma a)]^{1/2}$ Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ 2.36 Remarks; Conducted by: La Signature:
Checked by: LA Tang Signature: Date: Date:

CINOTECH

File No. MA5023/A40/0032 CAM2 - Hung Hing Printing Centre CH Station Operator: Date: 7-Jun-10 Next Due Date: 6-Aug-10 Equipment No.: A-01-40 Serial No. 10239 **Ambient Condition** 299.7 760.6 Temperature, Ta (K) Pressure, Pa (mmHg) Orifice Transfer Standard Information 0.0086 Equipment No.: A-04-06 Slope, mc 0.0448 Intercept, be mc x Qstd + bc = $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ 4-Nov-09 Last Calibration Date: Qstd = $\{ [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} -bc \} / mc$ Next Calibration Date: 3-Nov-10 Calibration of TSP Sampler Orfice HVS Calibration ΔH (orifice), $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2} \text{ Y-}$ Qstd (CFM) ΔW Point $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ in. of water X - axis (HVS), in. of oil axis 1 11.7 3.41 75.97 7.8 2.79 9.6 3.09 68.80 6.6 2.56 2 2.23 7.2 59.56 5.0 2.68 1.78 2.25 50.09 3.2 4 5.1 5 3.2 1.78 39.64 1.9 1.38 By Linear Regression of Y on X Slope , mw = _____ 0.0395 -0.1771 Intercept, bw: Correlation coefficient* = *If Correlation Coefficient < 0.990, check and recalibrate. Set Point Calculation From the TSP Field Calibration Curve, take Qstd = 43 CFM From the Regression Equation, the "Y" value according to mw x Qstd + bw = $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ Remarks: Conducted by: Date: Signature:



File No. MA0010/A40/0033

Station	CAM2 - Hung H	ing Printing Cen	tre	Operator:	СН		
Date:	5-Aug-10		1	Next Due Date:	4-Oct-	10	
Equipment No.:				Serial No.	10239		
			Ambient (Condition		÷.	
Temperatu	re, Ta (K)	303.3	Pressure, Pa	(mmHg)		756.4	
							1
		Oi	ifice Transfer St	andard Inform	ation		
Equipme	ent No.:	A-04-06	Slope, mc	0.0448	Intercept	,	.0086
Last Calibra		4-Nov-09			oc = [ΔH x (Pa/76		
Next Calibr		3-Nov-10		$Qstd = \{ [\Delta H :$	x (Pa/760) x (298	/Ta)] ^{1/2} -bc} / mc	
		1.0	Calibration of	TSP Sampler			
		Or	fice			HVS	
Calibration Point	ΔH (orifice), in. of water	[ΔH x (Pa/76	0) x (298/Ta)] ^{1/2}	Qstd (CFM) X - axis	ΔW (HVS), in. of oil	[ΔW x (Pa/760) x (29 axis	8/Ta)] ^{1/2} Y-
1	11.7	3	3.38	75.31	7.9	2.78	
2	9.8		3.10	68.91	6,6	2.54	
3	7,5	2	2.71	60.26	5.0	2.21	
4	5.0		2.21	49.16	3.1	1.74	
5	3.1		1.74	38.67	1.9	1.36	
Slope , mw = Correlation c	ession of Y on X 0.0391 oefficient* = Coefficient < 0.99	0.9	997	Intercept, bw -	-0,157	78	
	······································		Set Point 6	Calculation			
Erom the TCD E	ield Calibration C	hurua taka Oetdi		Cattulation			
	ssion Equation, th						
Floin the Kegies	Sion Equation, in	c i vanicucco	rung to				
		mw x	$Qstd + bw = [\Delta W]$	x (Pa/760) x (2	298/Ta)] ^{1/2}		
Therefore, S	et Point; W = (m	w x Qstd + bw)	² x (760 / Pa) x (Ta / 298)=	2.37		
Remarks:						<u> </u>	(n)
Conducted by: Checked by:	Luk Jang	Signature: Signature:	Kwa	1	- -	Date: <u>> 24</u> Date: <u>5 Au</u>	gust 2010

CINOTECH

File No. MA5023/35/0032 Station CAM3 - Talcon Industrial Ltd Operator: CH Date: 7-Jun-10 Next Due Date: 6-Aug-10 Equipment No.: A-01-35 0810 Serial No. Ambient Condition Temperature, Ta (K) 299.7 Pressure, Pa (mmHg) 760.6 Orifice Transfer Standard Information Intercept, be Equipment No.: A-04-06 Slope, mc 0.0448 0.0086 me x Qstd + be = $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ Last Calibration Date: 4-Nov-09 Qstd = $\{ [\Delta H \times (Pa/760) \times (298/Ta) \}^{1/2} - bc \} / mc$ Next Calibration Date: 3-Nov-10 Calibration of TSP Sampler Orfice HVS Calibration $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2} Y$ ΔH (orifice), Qstd (CFM) ΔW **Point** [\Delta H x (Pa/760) x (298/Ta)]1/2 in. of water X - axis (HVS), in. of oil axis l 11.7 3.41 75.97 7.9 2.80 9.9 2 69.87 3.14 6.5 2.54 3 7.3 2.70 59.97 2.19 4.8 4 5.1 2.25 50.09 3.3 1.81 5 3,3 1.81 40.26 2.0 1.41 By Linear Regression of Y on X Slope, mw = _____0.0385 Intercept, bw :______-0.1312 Correlation coefficient* = 0.9997 *If Correlation Coefficient < 0.990, check and recalibrate. · Set Point Calculation From the TSP Field Calibration Curve, take Qstd = 43 CFM From the Regression Equation, the "Y" value according to mw x Qstd + bw = $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ 2,34 Remarks: Conducted by: (Signature: Date: Checked by: (A Signature: Date:



File No. MA0010/35/0033 CH CAM3 - Talcon Industrial Ltd Operator: Station Next Due Date: 4-Oct-10 Date: 5-Aug-10 0810 Equipment No.: A-01-35 Serial No. **Ambient Condition** 303.3 Pressure, Pa (mmHg) 756.4 Temperature, Ta (K) Orifice Transfer Standard Information 0.0448 Intercept, be 0.0086 A-04-06 Equipment No.: Slope, mc me x Qstd + bc = $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ 4-Nov-09 Last Calibration Date: Qstd = $\{ [\Delta H \times (Pa/760) \times (298/Ta) \}^{1/2} - bc \} / mc$ Next Calibration Date: 3-Nov-10 Calibration of TSP Sampler Orfice Calibration $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2} Y$ Ostd (CFM) ΔW ΔH (orifice), **Point** [ΔH x (Pa/760) x (298/Ta)]1/2 (HVS), in. of oil in. of water X - axis axis 2.76 3.40 75.63 7.8 11.8 2 9.9 3.11 69.26 6.4 2.50 3 7.4 2.69 59.85 5.0 2.21 2.25 50.14 3.3 1.80 4 5.2 1.33 38.67 1.8 1.74 3.1 By Linear Regression of Y on X Slope, mw = 0.0385Correlation coefficient* = 0.9987 *If Correlation Coefficient < 0.990, check and recalibrate. Set Point Calculation From the TSP Field Calibration Curve, take Qstd = 43 CFM From the Regression Equation, the "Y" value according to mw x Qstd + bw = $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Therefore, Set Point; $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$ Remarks: Conducted by: Signature: Checked by: WK. Tans Signature: Date: Date:



WELLAB LIMITED

Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT: Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/A/100504 Date of Issue: 2010-05-04 Date Received: 2010-04-30 Date Tested: 2010-04-30 Date Completed: 2010-04-30

Page:

Next Due Date: 2011-05-03 1 of 1

ATTN:

Mr. Henry Leung

Certificate of Calibration

Item for calibration:

Description

: RS232 Integral Vane Digital Anemometer

Manufacturer

: AZ Instrument

Model No.

: 451104

Serial No.

: 9020746

Equipment No.

: A-03-01

Test conditions:

Room Temperature

: 22 degree Celsius

Relative Humidity

: 68%

Pressure

: 101.3 kPa

Methodology:

The anemometer has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

	Reference Set Point	Instrument Readings
Measuring Air Velocity, m/s	2.00	2.00
Temperature, °C	21.0	21.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE

Laboratory Manager

This report may not be reproduced except with prior written approval from WELLAB LIMITED and the results relate only to the items calibrated or tested.



TISCH ENVIROMENTAL, INC 145 SOUTH MIAM! AVE. VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5028A

Date - N Operator	ov 04, 200 Tisch	9 Rootsmeter Orifice I.		833620 1272	Ta (K) - Pa (mm)	295 - 758.19
PLATE OR VDC #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1 2 3 4 5	NA NA NA NA	NA NA NA NA NA	1.00 1.00 1.00 1.00 1.00	1.2800 0.9910 0.9050 0.8350 0.6320	4.2 7.1 8.5 9.9 17.1	1.50 2.50 3.00 3.50 6.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0021 0.9983 0.9964 0.9946 0.9850	.0.7829 1.0073 1.1010 1.1911 1.5586	1.2295 1.5873 1.7388 1.8781 2.4590	0.9944 0.9906 0.9887 0.9869 0.9774	0.7769 0.9996 1.0925 1.1819 1.5466	0.7640 0.9863 1.0804 1.1670 1.5279
Qstd slor intercept coefficie y axis =	(b) = ent (r) =	1.58420 -0.00884 0.99998 	 Qa slope intercept coefficie	(b) =	0.99200 -0.00549 0.99998

CALCULATIONS

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta) Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa] Qa = Va/Time


For subsequent flow rate calculations:

Qstd = $1/m\{ [SQRT(H2O(Pa/760)(298/Ta))] - b\}$ Qa = $1/m\{ [SQRT H2O(Ta/Pa)] - b\}$



TISCH ENVIROMENTAL, INC. 145 SOUTH MIAM! AVE. VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

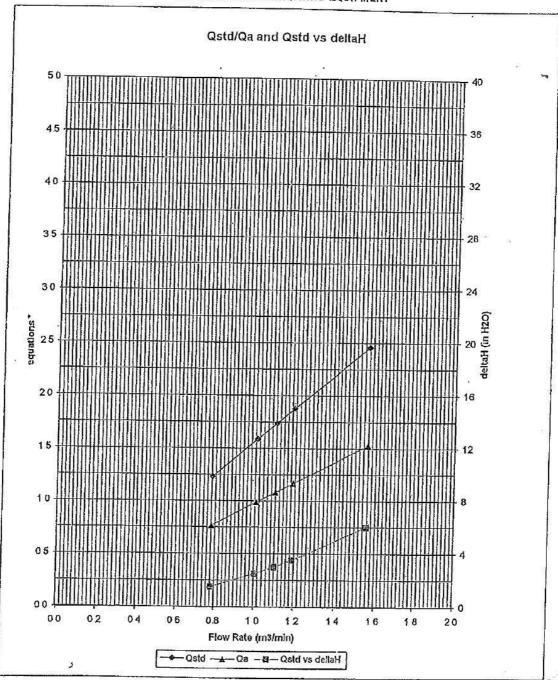

* y-axis equations:

Qstd series:

$$\sqrt{\Delta \, H \left(\frac{P \, a}{P \, s \, t \, d}\right) \left(\frac{T \, s \, t \, d}{T \, a}\right)}$$

Qa series;

$$\sqrt{(\Delta H (Ta/Pa))}$$



WELLAB LIMITED

Rms 816, 1516 & 1701, Technology Park, 18 On Lai Street, Shatin, N.T, Hong Kong. Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/100116/1
Date of Issue: 2010-01-16

Date Received: 2010-01-15 Date Tested: 2010-01-15

Date Completed: 2010-01-16 Next Due Date: 2011-01-15

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: 'SVANTEK' Integrating Sound Level Meter

Manufacturer

: SVANTEK

Model No.

: SVAN 955

Serial No.

: 14302 : 17204

Microphone No. Equipment No.

: N-08-04

Test conditions:

Room Temperatre

: 20 degree Celsius

Relative Humidity

: 55%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE

Laboratory Manager



WELLAB LIMITED
Rms 816, 1516 & 1701, Technology Park,
18 On Lai Street, Shatin, N.T, Hong Kong.
Tel: 2898 7388 Fax: 2898 7076

Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

 Test Report No.:
 C/N/100123/1

 Date of Issue:
 2010-01-23

 Date Received:
 2010-01-22

 Date Tested:
 2010-01-23

 Date Completed:
 2010-01-23

 Next Due Date:
 2011-01-22

ATTN:

Mr. Henry Leung

Page:

1 of 1

Certificate of Calibration

Item for calibration:

Description

: 'SVANTEK' Integrating Sound Level Meter

Manufacturer

: SVANTEK

Model No.
Serial No.

: SVAN 955 : 14303 : 17204

Microphone No. Equipment No.

: N-08-05

Test conditions:

Room Temperatre

: 21 degree Celsius

Relative Humidity

: 56%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:

In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB	
94	94.0	
114	114.0	

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE

Laboratory Manager



WELLAB LIMITED
Rms 816, 1516 & 1701, Technology Park,
18 On Lai Street, Shatin, N.T, Hong Kong.
Tel: 2898 7388 Fax: 2898 7076
Website: www.wellab.com.hk

TEST REPORT

APPLICANT:

Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.:	C/N/91114/1
Date of Issue:	2009-11-14
Date Received:	2009-11-13
Date Tested:	2009-11-13
Date Completed:	2009-11-14
Next Due Date:	2010-11-13

ATTN:

Mr. Henry Leung

Page:

1 of 1

Item for calibration:

Description

: Acoustical Calibrator

Manufacturer

: Brüel & Kjær

Model No.

: 4231

Serial No.

: 2326353

Project No.

: C13

Equipment No.

: N-02-01

Test conditions:

Room Temperatre

: 21 degree Celsius

Relative Humidity

: 60%

Pressure

: 1015.2 hPa

Methodology:

The sound calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level	Measured SPL	Tolerance		
At 94 dB SPL	94.0	94.0 ± 0.1 dB		

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE
Laboratory Manager

This report may not be reproduced except with prior written approval from WELLAB LIMITED and the results relate only to the items calibrated or tested.



Room 1516 & 816, Technology Park 18 On Lai Street, Shatin, N T., Hong Kong Tel: 2898 7388 Fax: 2898 7076 Website, http://www.wellab.com.hk E-mail: wellab/q/wellab.com.hk

TEST REPORT

APPLICANT: Cinotech Consultants Limited

Room 1710, Technology Park,

18 On Lai Street,

Shatin, NT, Hong Kong

Test Report No.: C/N/91109/1
Date of Issue: 2009-11-09
Date Received: 2009-11-07
Date Tested: 2009-11-07
Date Completed: 2009-11-09

Next Due Date:

2009-11-09 2010-11-08

ATTN:

Mr. Henry Leung

Page:

1 of 1

Item for calibration:

Description

: Acoustical Calibrator

Manufacturer Model No.

: SVANTEK : SV30A

Serial No.

: 10965

Equipment No.

: N-09-02

Test conditions:

Room Temperatre

: 21 degree Celsius

Relative Humidity

: 55%

Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance		
At 94 dB SPL	94.0	94.0 ± 0.1 dB		
At 114 dB SPL	114.0	114.0 ± 0.1 dB		

PREPARED AND CHECKED BY:

For and On Behalf of WELLAB Ltd.

PATRICK TSE

Laboratory Manager

This report may not be reproduced except with prior written approval from WELLAB LIMITED and the results relate only to the items calibrated or tested.



Calibration Certificate

Number: CCP/58935

Customer Name:

China Harbour Engineering Co; Ltd

Address:

19/F, China Harbour Building,

370-374 King's Road, North Point.

Hong Kong.

Contact Person:

Mr. Cheung

Detector Model:

Crowcon Custodian CDL Portable Gas Detector

Serial Number:

24800 37076

Sensor	Measuring	Alarm Le	vel Settings				
Туре	Range	Alarm 1	Alarm 2	STEL	LTEL	Test Gas	Result
СН4	0 to 100%LEL	20	40	NA	NA	50%LEL	Passed
H2S	0 to 25ppm	5	10	10	5	25ppm	Passed
O2	0 to 25%v/v	19.5	23.0	NA	NA	18.5%v/v	Passed
CO	0 to 250ppm	25	100	200	30	200ppm	Passed

Next Calibration Date: 3rd Sep 2010

Remarks:

- 1. "Passed" refers to the detector has been successfully calibrated to meet with manufacturer tolerance of the instrument & sensor specification and repeatability $\pm 5\%$ FSD.
- 2. The above equipment has been tested and calibrated in accordance with procedures referred to in Crowcon's BSI validated ISO9001 quality manual. Test equipment used has been factory calibrated and is traceable to national standards. Canned calibration gas has been prepared in accordance with BS4559 and original gas mixture has been prepared using NPL (UK) certified Gravimetric Standard. Gas generator has been tested to meet with: Mil Std 45662A/ANSI/NCSL Z540-1

Authorized Signatur

Date: 04/09/2009

FireMark Hong Kong Limited
Unit 901, 9/F., Lai Sun Commercial Center, 680 Cheung Sha Wan Road, Kowloon,
Hong Kong

Tel: (852) 2751 8871 Fax: (852) 2751 8806

APPENDIX C ENVIRONMENTAL MONITORING SCHEDULE

Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B Impact Air Quality and Noise Monitoring Schedule for August 2010

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1-Aug	2-Aug	3-Aug	4-Aug	5-Aug	6-Aug	7-Aug
		1 hr TSP Noise	1 hr TSP	1 hr TSP	24 hr TSP	
8-Aug	9-Aug	10-Aug	11-Aug	12-Aug	13-Aug	14-Aug
		1 hr TSP Noise	1 hr TSP	24 hr TSP	1 hr TSP	
15-Aug	16-Aug	17-Aug	18-Aug	19-Aug	20-Aug	21-Aug
	1 hr TSP		1 hr TSP 24 hr TSP		1 hr TSP Noise	
22-Aug	23-Aug	24-Aug	25-Aug	26-Aug	27-Aug	28-Aug
		1 hr TSP Noise 24 hr TSP		1 hr TSP	1 hr TSP	
29-Aug	30-Aug	31-Aug				
	24 hr TSP	1 hr TSP				
	21111101					

Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B Tentative Impact Air Quality and Noise Monitoring Schedule for September 2010

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			1-Sep	2-Sep	3-Sep	4-Sep
			1 hr TSP Noise	1 hr TSP Water Discharge		24 hr TSP
5-Sep	6-Sep	7-Sep	8-Sep	9-Sep	10-Sep	11-Sep
	1 hr TSP		1 hr TSP	1 hr TSP Noise	24 hr TSP	
12-Sep	13-Sep	14-Sep	15-Sep	16-Sep	17-Sep	18-Sep
	1 hr TSP			1 hr TSP 24 hr TSP	1 hr TSP Noise	
19-Sep	20-Sep	21-Sep	22-Sep	23-Sep	24-Sep	25-Sep
		1 hr TSP	1 hr TSP 24 hr TSP		1 hr TSP Noise	
26-Sep	27-Sep	28-Sep	29-Sep	30-Sep		
		1 hr TSP 24 hr TSP	1 hr TSP	1 hr TSP Noise		

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

APPENDIX D 1-HOUR TSP MONITORING RESULTS AND GRAPHICAL PRESENTATION

Appendix D - 1-hour TSP Monitoring Results

Station CAM1 Government Staff Quarters

Date	Sampling	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	e (m³/min.)	Av. flow	Total vol.	Conc.
Date	Time	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	(µg/m ³)
3-Aug-10	09:00	Sunny	301.3	759.2	3.1640	3.1728	0.0088	14474.1	14475.1	1.0	1.22	1.22	1.22	73.3	120
4-Aug-10	09:00	Sunny	302.6	757.3	3.1615	3.1723	0.0108	14475.1	14476.1	1.0	1.22	1.22	1.22	73.1	148
5-Aug-10	09:00	Sunny	303.2	756.5	3.1940	3.1979	0.0039	14476.1	14477.1	1.0	1.22	1.22	1.22	73.0	53
10-Aug-10	09:00	Sunny	302.9	757.5	3.2160	3.2207	0.0047	14501.1	14502.1	1.0	1.23	1.23	1.23	73.7	64
11-Aug-10	09:00	Cloudy	302.7	759.1	3.1579	3.1619	0.0040	14502.1	14503.1	1.0	1.23	1.23	1.23	73.8	54
13-Aug-10	10:00	Cloudy	302.7	759.5	3.1615	3.1683	0.0068	14527.1	14528.1	1.0	1.23	1.23	1.23	73.9	92
16-Aug-10	13:00	Cloudy	301.2	759.7	3.1502	3.1559	0.0057	14528.1	14529.1	1.0	1.23	1.23	1.23	74.0	77
18-Aug-10	09:00	Cloudy	300.3	761.6	3.2057	3.2091	0.0034	14529.1	14530.1	1.0	1.24	1.24	1.24	74.2	46
20-Aug-10	11:00	Sunny	300.7	762.4	3.1406	3.1498	0.0092	14554.1	14555.1	1.0	1.24	1.24	1.24	74.2	124
24-Aug-10	09:00	Cloudy	300.4	760.4	3.1798	3.1822	0.0024	14555.1	14556.1	1.0	1.24	1.24	1.24	74.1	32
26-Aug-10	11:00	Sunny	302.0	758.9	3.1617	3.1652	0.0035	14580.1	14581.1	1.0	1.23	1.23	1.23	73.9	47
27-Aug-10	09:00	Sunny	302.2	758.5	3.2005	3.2050	0.0045	14581.1	14582.1	1.0	1.23	1.23	1.23	73.9	61
31-Aug-10	13:00	Cloudy	306.1	753.6	3.1345	3.1388	0.0043	14606.1	14607.1	1.0	1.22	1.22	1.22	73.2	59
														Min	32
														Max	148
														Average	75

Station CAM2 Heng Hing Printing Centre

Date	Sampling	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	e (m³/min.)	Av. flow	Total vol.	Conc.
Date	Time	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	$(\mu g/m^3)$
3-Aug-10	09:00	Sunny	301.3	759.2	3.1929	3.2040	0.0111	23651.2	23652.2	1.0	1.21	1.21	1.21	72.4	153
4-Aug-10	09:00	Sunny	302.6	757.3	3.1939	3.2064	0.0125	23652.2	23653.2	1.0	1.20	1.20	1.20	72.2	173
5-Aug-10	09:00	Sunny	303.2	756.5	3.1735	3.1786	0.0051	23653.2	23654.2	1.0	1.20	1.20	1.20	72.1	71
10-Aug-10	09:00	Sunny	302.9	757.5	3.1529	3.1612	0.0083	23678.2	23679.2	1.0	1.22	1.22	1.22	73.5	113
11-Aug-10	09:00	Cloudy	302.7	759.1	3.1917	3.1986	0.0069	23679.2	23680.2	1.0	1.23	1.23	1.23	73.6	94
13-Aug-10	10:00	Cloudy	302.7	759.5	3.1669	3.1751	0.0082	23704.2	23705.2	1.0	1.23	1.23	1.23	73.6	111
16-Aug-10	13:00	Cloudy	301.2	759.7	3.1780	3.1845	0.0065	23705.2	23706.2	1.0	1.23	1.23	1.23	73.8	88
18-Aug-10	09:00	Cloudy	300.3	761.6	3.1621	3.1693	0.0072	23706.2	23707.2	1.0	1.23	1.23	1.23	73.9	97
20-Aug-10	11:00	Sunny	300.7	762.4	3.1878	3.1980	0.0102	23731.2	23732.2	1.0	1.23	1.23	1.23	73.9	138
24-Aug-10	09:00	Cloudy	300.4	760.4	3.1666	3.1741	0.0075	23732.2	23733.2	1.0	1.23	1.23	1.23	73.9	102
26-Aug-10	11:00	Sunny	302.0	758.9	3.1757	3.1820	0.0063	23757.2	23758.2	1.0	1.23	1.23	1.23	73.6	86
27-Aug-10	09:00	Sunny	302.2	758.5	3.1870	3.1926	0.0056	23758.2	23759.2	1.0	1.23	1.23	1.23	73.6	76
31-Aug-10	13:00	Cloudy	306.1	753.6	3.1363	3.1459	0.0096	23783.2	23784.2	1.0	1.22	1.22	1.22	73.0	132
														Min	71
														Max	173
														Average	110


MA0010/App D - 1hr TSP

Appendix D - 1-hour TSP Monitoring Results

Station CAM3 Talcon Industrial Ltd

Date	Sampling	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	e (m³/min.)	Av. flow	Total vol.	Conc.
Date	Time	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	$(\mu g/m^3)$
3-Aug-10	09:00	Sunny	301.3	759.2	3.2412	3.2533	0.0121	16914.9	16915.9	1.0	1.20	1.20	1.20	72.3	167
4-Aug-10	09:00	Sunny	302.6	757.3	3.1748	3.1893	0.0145	16915.9	16916.9	1.0	1.20	1.20	1.20	72.0	201
5-Aug-10	09:00	Sunny	303.2	756.5	3.1509	3.1596	0.0087	16916.9	16917.9	1.0	1.20	1.20	1.20	71.9	121
10-Aug-10	09:00	Sunny	302.9	757.5	3.1859	3.1954	0.0095	16941.9	16942.9	1.0	1.23	1.23	1.23	73.9	129
11-Aug-10	09:00	Cloudy	302.7	759.1	3.2080	3.2195	0.0115	16942.9	16943.9	1.0	1.23	1.23	1.23	74.0	155
13-Aug-10	10:00	Cloudy	302.7	759.5	3.1827	3.1922	0.0095	16967.9	16968.9	1.0	1.23	1.23	1.23	74.0	128
16-Aug-10	13:00	Cloudy	301.2	759.7	3.1496	3.1577	0.0081	16968.9	16969.9	1.0	1.24	1.24	1.24	74.2	109
18-Aug-10	09:00	Cloudy	300.3	761.6	3.1617	3.1691	0.0074	16969.9	16970.9	1.0	1.24	1.24	1.24	74.4	99
20-Aug-10	11:00	Sunny	300.7	762.4	3.1832	3.1942	0.0110	16994.9	16995.9	1.0	1.24	1.24	1.24	74.4	148
24-Aug-10	09:00	Cloudy	300.4	760.4	3.1641	3.1678	0.0037	16995.9	16996.9	1.0	1.24	1.24	1.24	74.3	50
26-Aug-10	11:00	Sunny	302.0	758.9	3.1913	3.1997	0.0084	17020.9	17021.9	1.0	1.23	1.23	1.23	74.1	113
27-Aug-10	09:00	Sunny	302.2	758.5	3.1835	3.1921	0.0086	17021.9	17022.9	1.0	1.23	1.23	1.23	74.0	116
31-Aug-10	13:00	Cloudy	306.1	753.6	3.1865	3.1975	0.0110	17046.9	17047.9	1.0	1.22	1.22	1.22	73.4	150
														Min	50
														Max	201
														Average	130

MA0010/App D - 1hr TSP

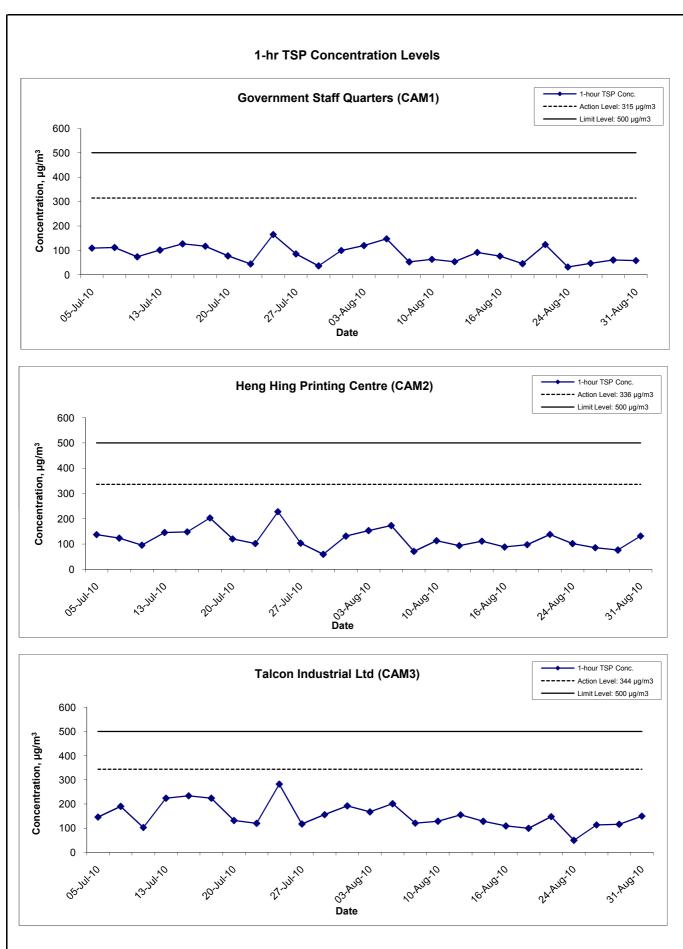

Title Contract No. DC/2009/09
Construction of Tai Po Sewage Treatment Works - Stage V Phase II B
Graphical Presentation of 1-hour TSP Impact Monitoring Results

Scale N.T.S No. MA0010
Date Aug 10

Appendix D

APPENDIX E 24-HOUR TSP MONITORING RESULTS AND GRAPHICAL PRESENTATION

Appendix E - 24-hour TSP Monitoring Results

Station CAM1 Government Staff Quarters

Start Date	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	e (m³/min.)	Av. flow	Total vol.	Conc.
Start Date	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	$(\mu g/m^3)$
6-Aug-10	Sunny	300.3	757.6	3.2049	3.3090	0.1041	14477.1	14501.1	24.0	1.23	1.23	1.23	1776.9	59
12-Aug-10	Cloudy	302.1	760.2	3.1635	3.2562	0.0927	14503.1	14527.1	24.0	1.23	1.23	1.23	1774.7	52
18-Aug-10	Cloudy	300.5	761.4	3.1844	3.2093	0.0249	14530.1	14554.1	24.0	1.24	1.24	1.24	1780.2	14
24-Aug-10	Cloudy	301.5	759.9	3.1932	3.2200	0.0268	14556.1	14580.1	24.0	1.23	1.23	1.23	1776.0	15
30-Aug-10	Cloudy	302.1	754.3	3.1170	3.1821	0.0651	14582.1	14606.1	24.0	1.23	1.23	1.23	1768.6	37
													Min	14
													Max	59
													Average	35


Station CAM2 Heng Hing Printing Centre

Start Date	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	e Time	Sampling	Flow Rate	(m³/min.)	Av. flow	Total vol.	Conc.
Start Date	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m ³)	(µg/m³)
6-Aug-10	Sunny	300.3	757.6	3.1893	3.3523	0.1630	23654.2	23678.2	24.0	1.23	1.23	1.23	1770.5	92
12-Aug-10	Cloudy	302.1	760.2	3.1151	3.2158	0.1007	23680.2	23704.2	24.0	1.23	1.23	1.23	1768.3	57
18-Aug-10	Cloudy	300.5	761.4	3.1868	3.2330	0.0462	23707.2	23731.2	24.0	1.23	1.23	1.23	1773.9	26
24-Aug-10	Cloudy	301.5	759.9	3.1837	3.2336	0.0499	23733.2	23757.2	24.0	1.23	1.23	1.23	1769.6	28
30-Aug-10	Cloudy	302.1	754.3	3.1849	3.2573	0.0724	23759.2	23783.2	24.0	1.22	1.22	1.22	1762.1	41
													Min	26
													Max	92
													Average	49

Station CAM3 Talcon Industrial Ltd

Start Date	Weather	Air	Atmospheric	Filter W	eight (g)	Particulate	Elapse	Time	Sampling	Flow Rate	(m³/min.)	Av. flow	Total vol.	Conc.
Start Date	Condition	Temp. (K)	Pressure (Pa)	Initial	Final	weight (g)	Initial	Final	Time(hrs.)	Initial	Final	(m ³ /min)	(m^3)	$(\mu g/m^3)$
6-Aug-10	Sunny	300.3	757.6	3.1833	3.3665	0.1832	16917.9	16941.9	24.0	1.24	1.24	1.24	1781.3	103
12-Aug-10	Cloudy	302.1	760.2	3.1930	3.3223	0.1293	16943.9	16967.9	24.0	1.24	1.24	1.24	1779.0	73
18-Aug-10	Cloudy	300.5	761.4	3.1745	3.2378	0.0633	16970.9	16994.9	24.0	1.24	1.24	1.24	1784.7	35
24-Aug-10	Cloudy	301.5	759.9	3.1558	3.2342	0.0784	16996.9	17020.9	24.0	1.24	1.24	1.24	1780.3	44
30-Aug-10	Cloudy	302.1	754.3	3.1568	3.2817	0.1249	17022.9	17046.9	24.0	1.23	1.23	1.23	1772.7	70
-						-			-			-	Min	35
													Max	103
													Average	65

MA0010/App E - 24hr TSP

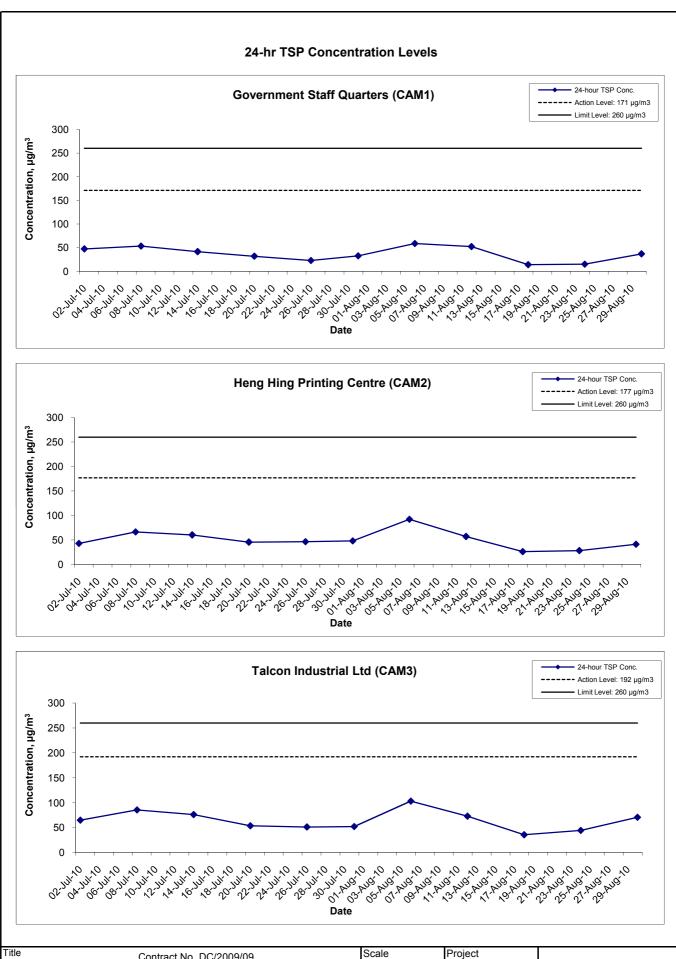

Contract No. DC/2009/09
Construction of Tai Po Sewage Treatment Works - Stage V Phase II B
Graphical Presentation of 24-hour TSP Impact Monitoring
Results




APPENDIX F NOISE MONITORING RESULTS AND GRAPHICAL PRESENTATION

Appendix F - Noise Monitoring Results

Location NM1	- Governme	ent Staff Quart	ters		
Data	Time	\A/a atla a r	dE	3 (A) (30-min)	
Date	Time	Weather	L _{eq}	L ₁₀	L 90
3-Aug-10	13:00	Sunny	67.9	69.5	66.0
10-Aug-10	11:00	Fine	67.2	69.5	66.0
20-Aug-10	10:10	Sunny	63.8	66.4	59.8
24-Aug-10	13:00	Fine	68.1	69.4	66.5
		Average	67.0	68.9	65.2
		Minimum	63.8	66.4	59.8
		Maximum	68.1	69.5	66.5

MA0010/App F - Noise Cinotech

Noise Levels

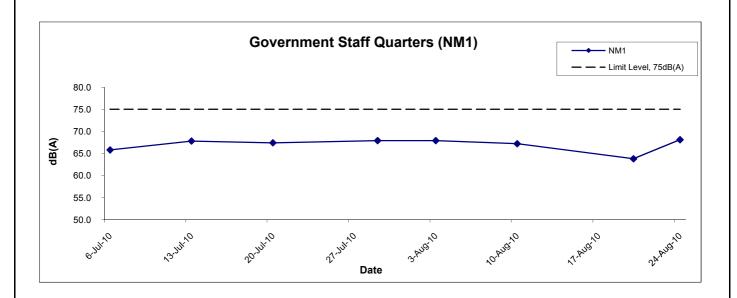

Title Contract No. DC/2009/09
Construction of Tai Po Sewage Treatment Works - Stage V Phase II B
Graphical Presentation of Construction Noise Monitoring

Results

Scale	N.T.S	Project No.	MA0010
Date		Appendix	(
	Aug 10		F



APPENDIX G RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
EC11D and EC12D	2-Aug-10	8:30 AM	79.1	0	0	20.9
FC11B and FC12B	2-Aug-10	1:30 PM	79.1	0	0	20.9
	3-Aug-10	8:30 AM	79.1	0	0	20.9
	3-Aug-10	1:30 PM	79.1	0	0	20.9
	4-Aug-10	8:30 AM	79.1	0	0	20.9
	4-Aug-10	1:30 PM	79.1	0	0	20.9
	5-Aug-10	8:30 AM	79.1	0	0	20.9
	5-Aug-10	1:30 PM	79.1	0	0	20.9
	6-Aug-10	8:30 AM	79.1	0	0	20.9
	6-Aug-10	1:30 PM	79.1	0	0	20.9
	7-Aug-10	8:30 AM	79.1	0	0	20.9
	7-Aug-10	1:30 PM	79.1	0	0	20.9
	9-Aug-10	8:30 AM	79.1	0	0	20.9
	9-Aug-10	1:30 PM	79.1	0	0	20.9
	10-Aug-10	8:30 AM	79.1	0	0	20.9
	10-Aug-10	1:30 PM	79.1	0	0	20.9
	11-Aug-10	8:30 AM	79.1	0	0	20.9
	11-Aug-10	1:30 PM	79.1	0	0	20.9
	12-Aug-10	8:30 AM	79.1	0	0	20.9
	12-Aug-10	1:30 PM	79.1	0	0	20.9
	13-Aug-10	8:30 AM	79.1	0	0	20.9
	13-Aug-10	1:30 PM	79.1	0	0	20.9
	14-Aug-10	8:30 AM	79.1	0	0	20.9
	14-Aug-10	1:30 PM	79.1	0	0	20.9
	16-Aug-10	8:30 AM	79.1	0	0	20.9
	16-Aug-10	1:30 PM	79.1	0	0	20.9
	17-Aug-10	8:30 AM	79.1	0	0	20.9
	17-Aug-10 17-Aug-10	1:30 PM	79.1	0	0	20.9
	18-Aug-10	8:30 AM	79.1	0	0	20.9
	18-Aug-10	1:30 PM	79.1	0	0	20.9
			79.1	0	0	20.9
	19-Aug-10 19-Aug-10	8:30 AM 1:30 PM	79.1	0	0	20.9
	20-Aug-10	8:30 AM	79.1	0	0	20.9
	20-Aug-10 20-Aug-10	1:30 PM	79.1	0	0	20.9
	20-Aug-10 21-Aug-10		79.1	0	0	20.9
		8:30 AM 1:30 PM	79.1	0	0	20.9
	21-Aug-10		79.1	0	0	20.9
	23-Aug-10 23-Aug-10	8:30 AM 1:30 PM	79.1	0	0	20.9
		8:30 AM	79.1	0	0	20.9
	24-Aug-10 24-Aug-10	1:30 PM	79.1	0	0	20.9
			79.1	0	0	20.9
	25-Aug-10	8:30 AM				
	25-Aug-10	1:30 PM	79.1	0	0	20.9
	26-Aug-10	8:30 AM	79.1	0	0	20.9
	26-Aug-10	1:30 PM	79.1	0	0	20.9
	27-Aug-10	8:30 AM	79.1	0	0	20.9
	27-Aug-10	1:30 PM	79.1	0	0	20.9
	28-Aug-10	8:30 AM	79.1	0	0	20.9
	28-Aug-10	1:30 PM	79.1	0	0	20.9
	30-Aug-10	8:30 AM	79.1	0	0	20.9
	30-Aug-10	1:30 PM	79.1	0	0	20.9
	31-Aug-10	8:30 AM	79.1	0	0	20.9
	31-Aug-10	1:30 PM	79.1	0	0	20.9

APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR


Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
Pipe 600 Excacvtion Trench	2-Aug-10	8:15 AM	79.1	0	0	20.9
Fipe 600 Excacvilon Trench	2-Aug-10	1:15 PM	79.1	0	0	20.9
	3-Aug-10	8:15 AM	79.1	0	0	20.9
	3-Aug-10	1:15 PM	79.1	0	0	20.9
	4-Aug-10	8:15 AM	79.1	0	0	20.9
	4-Aug-10	1:15 PM	79.1	0	0	20.9
	5-Aug-10	8:15 AM	79.1	0	0	20.9
	5-Aug-10	1:15 PM	79.1	0	0	20.9
	6-Aug-10	8:15 AM	79.1	0	0	20.9
	6-Aug-10	1:15 PM	79.1	0	0	20.9
	7-Aug-10	8:15 AM	79.1	0	0	20.9
	7-Aug-10	1:15 PM	79.1	0	0	20.9
	9-Aug-10	8:15 AM	79.1	0	0	20.9
	9-Aug-10	1:15 PM	79.1	0	0	20.9
	10-Aug-10	8:15 AM	79.1	0	0	20.9
	10-Aug-10	1:15 PM	79.1	0	0	20.9
	11-Aug-10	8:15 AM	79.1	0	0	20.9
	11-Aug-10	1:15 PM	79.1	0	0	20.9
	12-Aug-10	8:15 AM	79.1	0	0	20.9
	12-Aug-10	1:15 PM	79.1	0	0	20.9
	13-Aug-10	8:15 AM	79.1	0	0	20.9
	13-Aug-10	1:15 PM	79.1	0	0	20.9
	14-Aug-10	8:15 AM	79.1	0	0	20.9
	14-Aug-10	1:15 PM	79.1	0	0	20.9
	16-Aug-10	8:15 AM	79.1	0	0	20.9
	16-Aug-10	1:15 PM	79.1	0	0	20.9
	17-Aug-10	8:15 AM	79.1	0	0	20.9
	17-Aug-10	1:15 PM	79.1	0	0	20.9
	18-Aug-10	8:15 AM	79.1	0	0	20.9
	18-Aug-10	1:15 PM	79.1	0	0	20.9
	19-Aug-10	8:15 AM	79.1	0	0	20.9
	19-Aug-10	1:15 PM	79.1	0	0	20.9


APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR


Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
	2-Aug-10	8:25 AM	79.1	0	0	20.9
Pipe 900 Excacvtion Trench	2-Aug-10 2-Aug-10	1:25 PM	79.1	0	0	20.9
	3-Aug-10	8:25 AM	79.1	0	0	20.9
	3-Aug-10	1:25 PM	79.1	0	0	20.9
	4-Aug-10	8:25 AM	79.1	0	0	20.9
	4-Aug-10 4-Aug-10	1:25 PM	79.1	0	0	20.9
	5-Aug-10	8:25 AM	79.1	0	0	20.9
	5-Aug-10 5-Aug-10	1:25 PM	79.1	0	0	20.9
		8:25 AM	79.1	0	0	20.9
	6-Aug-10					
	6-Aug-10	1:25 PM	79.1	0	0	20.9
	7-Aug-10	8:25 AM	79.1	0	0	20.9
	7-Aug-10	1:25 PM	79.1	0	0	20.9
	9-Aug-10	8:25 AM	79.1	0	0	20.9
	9-Aug-10	1:25 PM	79.1	0	0	20.9
	10-Aug-10	8:25 AM	79.1	0	0	20.9
	10-Aug-10	1:25 PM	79.1	0	0	20.9
	11-Aug-10	8:25 AM	79.1	0	0	20.9
	11-Aug-10	1:25 PM	79.1	0	0	20.9
	12-Aug-10	8:25 AM	79.1	0	0	20.9
	12-Aug-10	1:25 PM	79.1	0	0	20.9
	13-Aug-10	8:25 AM	79.1	0	0	20.9
	13-Aug-10	1:25 PM	79.1	0	0	20.9
	14-Aug-10	8:25 AM	79.1	0	0	20.9
	14-Aug-10	1:25 PM	79.1	0	0	20.9
	16-Aug-10	8:25 AM	79.1	0	0	20.9
	16-Aug-10	1:25 PM	79.1	0	0	20.9
	17-Aug-10	8:25 AM	79.1	0	0	20.9
	17-Aug-10	1:25 PM	79.1	0	0	20.9
	18-Aug-10	8:25 AM	79.1	0	0	20.9
	18-Aug-10	1:25 PM	79.1	0	0	20.9
	19-Aug-10	8:25 AM	79.1	0	0	20.9
	19-Aug-10	1:25 PM	79.1	0	0	20.9
	20-Aug-10	8:25 AM	79.1	0	0	20.9
	20-Aug-10	1:25 PM	79.1	0	0	20.9
	21-Aug-10	8:25 AM	79.1	0	0	20.9
	21-Aug-10 21-Aug-10	1:25 PM	79.1	0	0	20.9
	23-Aug-10	8:25 AM	79.1	0	0	20.9
	23-Aug-10 23-Aug-10	1:25 PM	79.1	0	0	20.9
	24-Aug-10	8:25 AM	79.1	0	0	20.9
	24-Aug-10 24-Aug-10	1:25 PM	79.1	0	0	20.9
	24-Aug-10 25-Aug-10	8:25 AM	79.1	0	0	20.9
	25-Aug-10 25-Aug-10	1:25 PM	79.1	0	0	20.9
			79.1		0	
	26-Aug-10	8:25 AM		0		20.9
	26-Aug-10	1:25 PM	79.1	0	0	20.9
	27-Aug-10	8:25 AM	79.1	0	0	20.9
	27-Aug-10	1:25 PM	79.1	0	0	20.9
	28-Aug-10	8:25 AM	79.1	0	0	20.9
	28-Aug-10	1:25 PM	79.1	0	0	20.9
	30-Aug-10	8:25 AM	79.1	0	0	20.9
	30-Aug-10	1:25 PM	79.1	0	0	20.9
	31-Aug-10	8:25 AM	79.1	0	0	20.9
	31-Aug-10	1:25 PM	79.1	0	0	20.9


APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
	2-Aug-10	8:05 AM	79.1	0	0	20.9
Pipe 300 Excacvtion Trench	2-Aug-10	1:05 PM	79.1	0	0	20.9
	3-Aug-10	8:05 AM	79.1	0	0	20.9
	3-Aug-10	1:05 PM	79.1	0	0	20.9
	4-Aug-10	8:05 AM	79.1	0	0	20.9
	4-Aug-10	1:05 PM	79.1	0	0	20.9
	5-Aug-10	8:05 AM	79.1	0	0	20.9
	5-Aug-10 5-Aug-10	1:05 PM	79.1	0	0	20.9
	6-Aug-10	8:05 AM	79.1	0	0	20.9
	6-Aug-10	1:05 PM	79.1	0	0	20.9
	7-Aug-10	8:05 AM	79.1	0	0	20.9
	7-Aug-10 7-Aug-10	1:05 PM	79.1	0	0	20.9
	9-Aug-10	8:05 AM	79.1	0	0	20.9
		1:05 PM	79.1	0	0	20.9
	9-Aug-10	8:05 AM	79.1	0	0	20.9
	10-Aug-10					
	10-Aug-10	1:05 PM	79.1	0	0	20.9
	11-Aug-10	8:05 AM	79.1	0	0	20.9
	11-Aug-10	1:05 PM	79.1	0	0	20.9
	12-Aug-10	8:05 AM	79.1	0	0	20.9
	12-Aug-10	1:05 PM	79.1	0	0	20.9
	13-Aug-10	8:05 AM	79.1	0	0	20.9
	13-Aug-10	1:05 PM	79.1	0	0	20.9
	14-Aug-10	8:05 AM	79.1	0	0	20.9
	14-Aug-10	1:05 PM	79.1	0	0	20.9
	16-Aug-10	8:05 AM	79.1	0	0	20.9
	16-Aug-10	1:05 PM	79.1	0	0	20.9
	17-Aug-10	8:05 AM	79.1	0	0	20.9
	17-Aug-10	1:05 PM	79.1	0	0	20.9
	18-Aug-10	8:05 AM	79.1	0	0	20.9
	18-Aug-10	1:05 PM	79.1	0	0	20.9
	19-Aug-10	8:05 AM	79.1	0	0	20.9
	19-Aug-10	1:05 PM	79.1	0	0	20.9
	20-Aug-10	8:05 AM	79.1	0	0	20.9
	20-Aug-10	1:05 PM	79.1	0	0	20.9
	21-Aug-10	8:05 AM	79.1	0	0	20.9
	21-Aug-10	1:05 PM	79.1	0	0	20.9
	23-Aug-10	8:05 AM	79.1	0	0	20.9
	23-Aug-10	1:05 PM	79.1	0	0	20.9
	24-Aug-10	8:05 AM	79.1	0	0	20.9
	24-Aug-10	1:05 PM	79.1	0	0	20.9
	25-Aug-10	8:05 AM	79.1	0	0	20.9
	25-Aug-10	1:05 PM	79.1	0	0	20.9
	26-Aug-10	8:05 AM	79.1	0	0	20.9
-	26-Aug-10	1:05 PM	79.1	0	0	20.9
-	27-Aug-10	8:05 AM	79.1	0	0	20.9
	27-Aug-10	1:05 PM	79.1	0	0	20.9
	28-Aug-10	8:05 AM	79.1	0	0	20.9
	28-Aug-10	1:05 PM	79.1	0	0	20.9
	30-Aug-10	8:05 AM	79.1	0	0	20.9
	30-Aug-10 30-Aug-10	1:05 PM	79.1	0	0	20.9
		1.W.) FIVI	12.1	U	U	∠0.9
	31-Aug-10	8:05 AM	79.1	0	0	20.9

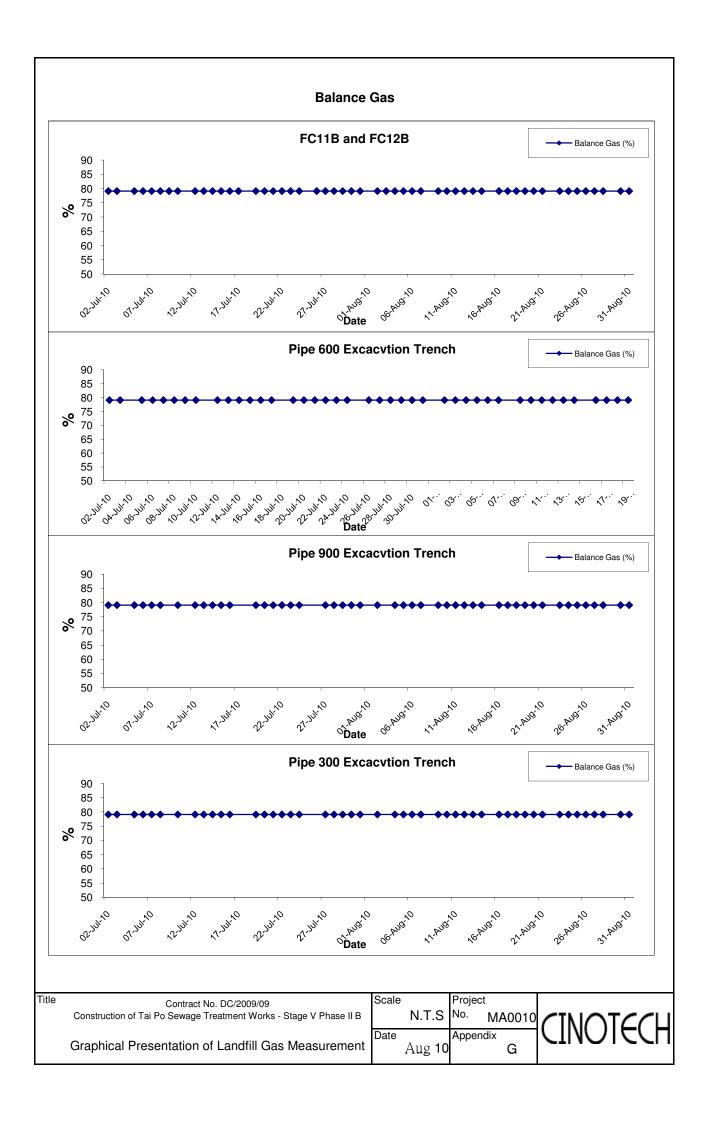

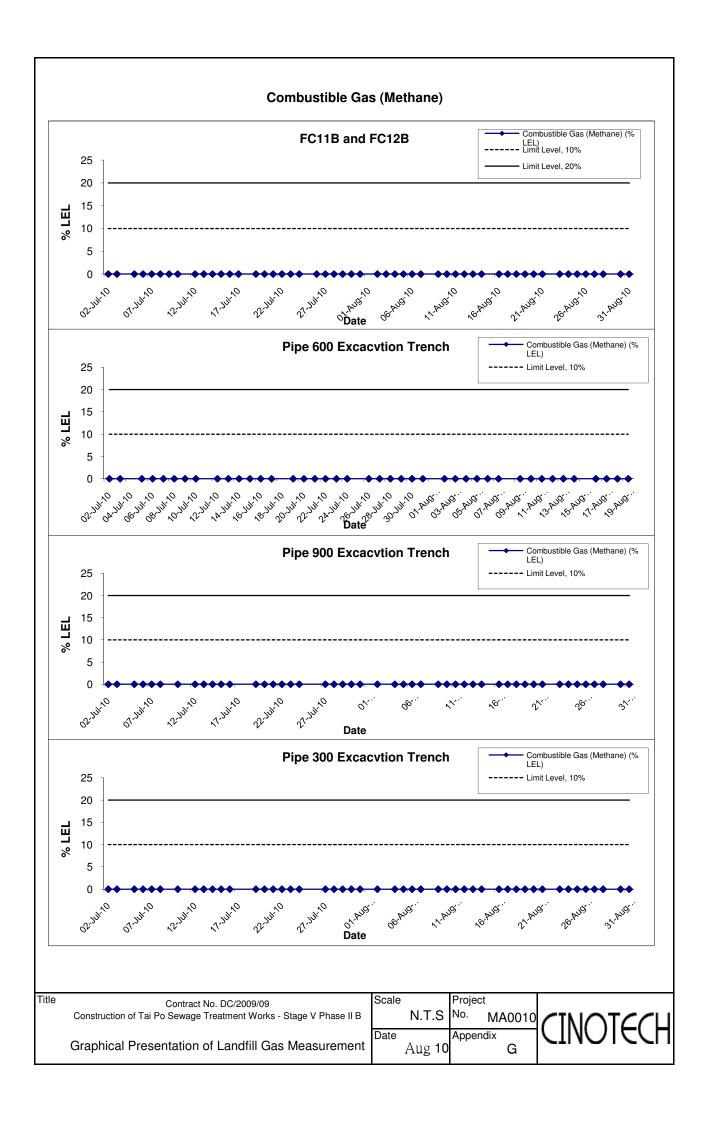

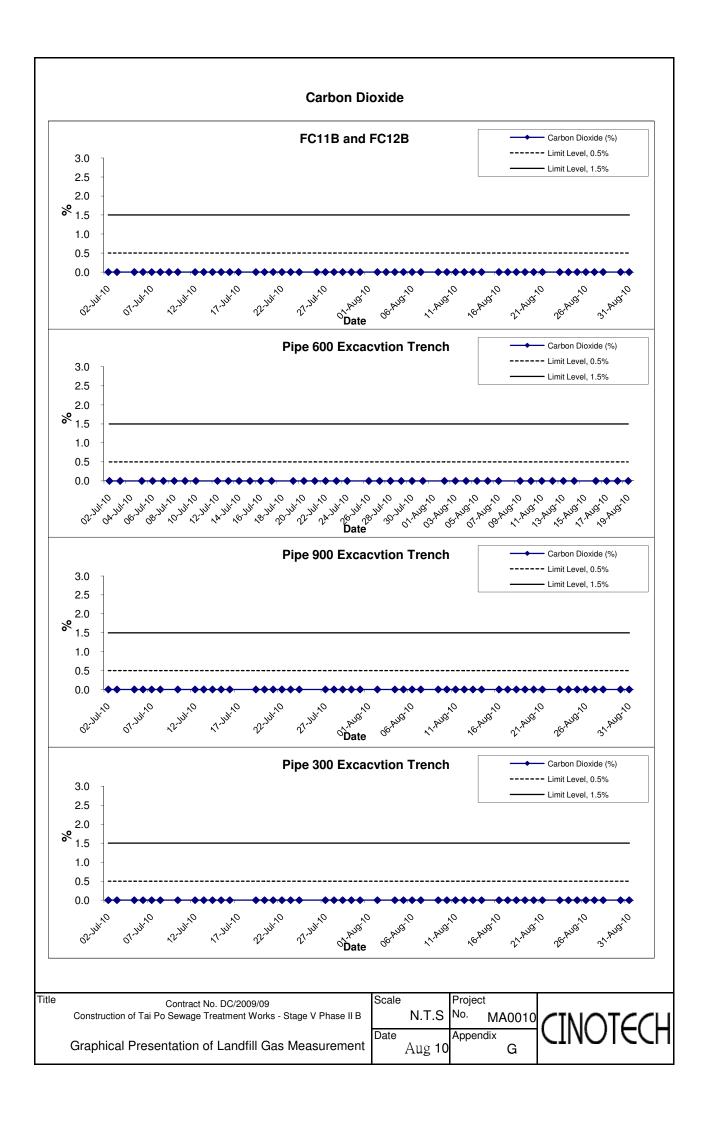

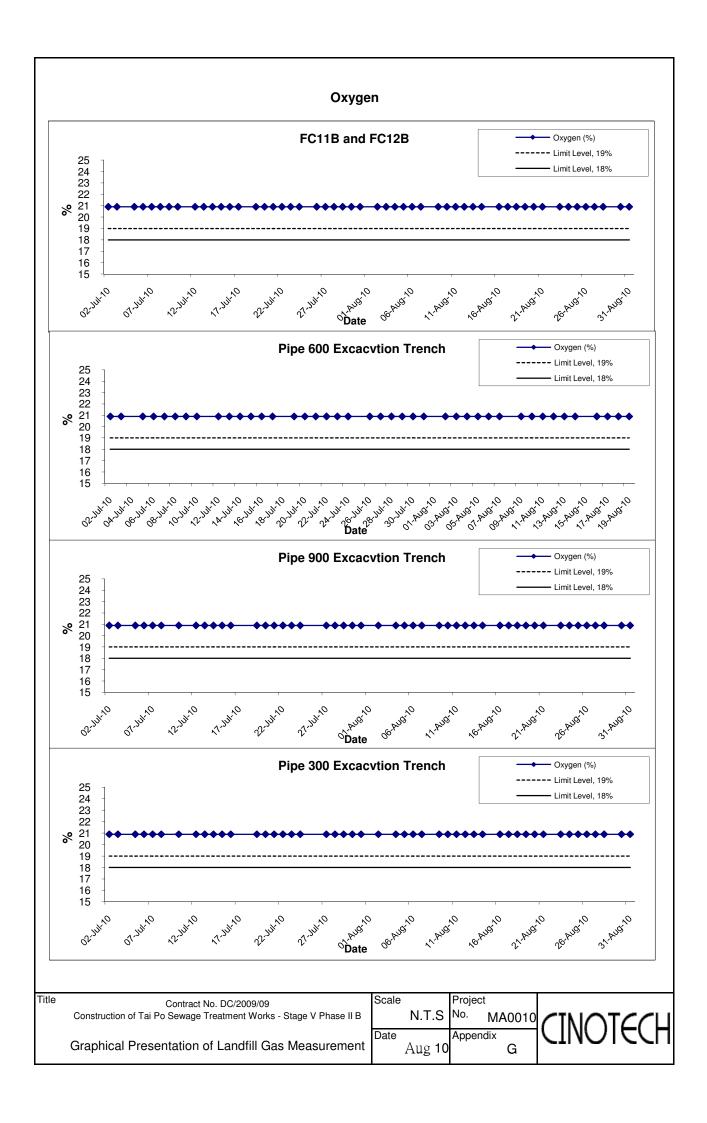

APPENDIX H SUMMARY OF EXCEEDANCE

APPENIDX H – SUMMARY OF EXCEEDANCE

Reporting Month: August 2010

- a) Exceedance Report for 1-hr TSP (NIL)
- b) Exceedance Report for 24-hr TSP (NIL)
- c) Exceedance Report for Construction Noise (NIL)
- d) Exceedance Report for Landfill Gas (NIL)

APPENDIX I SITE AUDIT SUMMARY

Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	100806
Date	6 th August 2010 (Thursday)
Time	15:45-17:00

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
1	Part B - Water Quality	
100806-O01	• Silty water was observed from the outflow of the sedimentation tank at FC11B and FC12B. The contractor was reminded to improve the sediment	B5iii
100806-O02	 silt was observed in the U-channel near the office at TPSTW. The contractor was reminded to clear it 	B12
100806-O03	• Improve the bunds near the U-channel near the office at TPSTW.	В2
100806-O04	Stagnant water was observed inside the drip tray near TPSTW site office. The contractor was reminded to treat it as chemical waste and clear it.	B12
100806-O06	Stagnant water was observed near the TPSTW site office. The contractor was reminded to clear it.	B12
100806-O07	• Direct discharge was observed at 600 pipe. The contractor was reminded to provide proper treatment before discharge.	ВЗі
100806-O08	Stagnant water was observed near A-Tank. The contractor was reminded to clear it.	B12
	Part C - Air Quality	
	No environmental deficiency was identified during the site inspection.	
	Part D – Noise	
	No environmental deficiency was identified during the site inspection.	
100806-O05	Part E - Waste / Chemical Management Larger drip tray is required near the TPSTW. Site office. The contractor was reminded to provide a drip tray 1.1 times larger than oil drum.	E7ii
	Part F - Permit / Licenses	
	No environmental deficiency was identified during the site inspection.	
	Others	
	No environmental deficiency was identified during the site inspection.	
	• Follow-up on the previous audit sessions (Ref. No.100729), the item no. 100729-O01, 100729-O02, 100729-O03 and 100729-O05 were still observed at the site area during the site inspection (Ref no. 100806). These items are remarked as Ref no. 100806-O06, 100806-O04, 100806-O05 and 100806-O08 respectively.	

CINOTECH MA0010 100809_audit100806

Contract No. DC/2009/09

Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B

Record Summary of Environmental Site Inspection

	Name	Signature	Date
Recorded by	Sam Lam	San	6 August 2010
Checked by	Dr. Priscilla Choy	W.T.	6 August 2010

Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	100813
Date	13 th August 2010 (Friday)
Time	10:00-11:00

Ref. No.	Non-Compliance	Related Item No.
_	None identified	-

Related Item No. Ref. No. Remarks/Observations Part B - Water Quality • Stagnant water was observed in the drip tray of the pumping equipment near **B12** 100813-O01 A-Tank. The contractor was reminded to clear it and treat as chemical · Silty water was observed from the outflow of the sedimentation tank at B5iii 100813-O02 FC11B and FC12B. The contractor was reminded to improve the sediment process. Part C - Air Quality • No environmental deficiency was identified during the site inspection. Part D - Noise • No environmental deficiency was identified during the site inspection. Part E - Waste / Chemical Management • General refuse was observed at the entrance of the construction area near Eli & Eliii 100813-O02 A-Tank. The contractor was reminded to clear it. Part F - Permit / Licenses • No environmental deficiency was identified during the site inspection. Others No environmental deficiency was identified during the site inspection. • Follow-up on the previous audit sessions (Ref. No.100806), the item no. 100806-O01 was still observed at the site area during the site inspection (Ref no. 100813). These items are remarked as Ref no. 100813-O03.

am Si-	13 August 2010
a Choy N.L.	13 August 2010
-	am San A Choy

CINOTECH MA0010 100820_audit100813

Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	100819	
Date	19th August 2010 (Thursday)	
Time	09:30-11:30	

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No. Remarks/Observations Related Item No. Part B - Water Quality 100819-002 · Stagnant water was observed in the drip tray of the pumping equipment near B12. A-Tank. The contractor was reminded to clean it. 100819-O03 · Open Stockpile was observed in Between M1 and M2. The contractor was B10. reminded to cover it properly. Part C - Air Quality • No environmental deficiency was identified during the site inspection. Part D - Noise • No environmental deficiency was identified during the site inspection. Part E - Waste / Chemical Management 100819-O01 • The drip tray at the pumping equipment near A-Tank was observed without E7ii. maintain properly (broken bottom). The contractor was reminded to repair Part F - Permit / Licenses · No environmental deficiency was identified during the site inspection. Others · No environmental deficiency was identified during the site inspection. • Follow-up on the previous audit sessions (Ref. No.100813), the item no. 100813TP-O01 was still observed at the site area during the site inspection (Ref no. 100819TP). These items are remarked as Ref no. 100819TP-O02.

	Name	Signature	Date
Recorded by	Sam Lam	S	19 August 2010
Checked by	Dr. Priscilla Choy	Wife	19 August 2010

CINOTECH MA0010 100820 audit100819

Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	100826
Date	26 th August 2010 (Thursday)
Time	15:00-16:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
100826-O03	Part B - Water Quality • Silt was observed in the U-channel at 600 pipe. The contractor was	B7
100020 003	reminded to clear it.	_,
	Part C - Air Quality	
	No environmental deficiency was identified during the site inspection.	
	Part D - Noise	
	No environmental deficiency was identified during the site inspection.	
	Part E - Waste / Chemical Management	
100826-O02	Oil drum was observed standing on the ground at FC11B and FC12B area. The contractor was reminded to provide drip tray and proper label.	E7ii.
	Part F - Permit / Licenses	
	No environmental deficiency was identified during the site inspection.	
	Others	
100826-O01	The contractor was reminded to repair the fencing of the tree protection zone at FC11B and FC12B area.	
	Follow-up on the previous audit sessions (Ref. No.100819),all environmental deficiencies have been Improved/ rectified during site inspection.	

	Name	Signature	Date
Recorded by	Sam Lam	<i>δ</i> —	26 August 2010
Checked by	Dr. Priscilla Choy	WZ	26 August 2010
		\	

CINOTECH MA0010 100827_audit100826

APPENDIX J EVENT ACTION PLANS

APPENDIX J (1) – Event Action Plan for Air Quality Monitoring (Construction Phase)

EVENT	ACTION						
EVENI	ET	IEC	ER	CONTRACTOR			
ACTION LEVEL	ACTION LEVEL						
Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily.	Check monitoring data submitted by ET; Check Contractor's working method.	1. Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.			
Exceedance for two or more consecutive samples	 Identify source; Inform IC(E) and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	Confirm receipt of notification of exceedance in writing; Ensure remedial measures properly implemented.	Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate.			
LIMIT LEVEL							
Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform Contractor, IEC, ER, and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.	Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures.	Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented.	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.			
Exceedance for two or more consecutive samples	Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results; If exceedance stops, cease additional monitoring.	Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures.	1. Confirm receipt of notification of exceedance in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.			

APPENDIX J (2) – Event Action Plan for Construction Noise Monitoring (Construction Phase)

EVENT		ACT	TION	
EVENI	ET	IEC	ER	CONTRACTOR
ACTION LEVEL	 Notify IEC and Contractor; Carry out investigation; Report the results of investigation to the IEC, ER and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness. 	 Review the analyzed results submitted by the ET; Review the propose d remedial measures by the Contractor and advise the ER accordingly; Supervise the implementation of remedial measures. 	1.Confirm receipt of notification of failure in writing; 2.Notify Contractor; 3.Require Contractor to propose remedial measures for the analyzed noise problem; 4.Ensure remedial measures are properly implemented.	 Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.
LIMIT LEVEL	 Identify source; Inform IEC, ER, EPD and Contractor; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, ER and EPD the causes and actions taken for the exceedances; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

APPENDIX J (3) – Event Action Plan for Landfill Gas Monitoring (Construction Phase)

Parameter	Limit Level	Action Required
Oxygen	<19%	Ventilate to restore oxygen to >19%
	<18%	Stop works;
		Evacuate personnel / prohibit entry;
		Increase ventilation to restore oxygen to > 19%
Methane	>10% LEL (i.e. >0.5% by volume)	Post "no smoking signs;
		Prohibit hot works;
		Ventilate to restore methane to <10% LEL
	>20% LEL (i.e. >1% by volume)	Stop works;
		Evacuate personnel / prohibit entry;
		Increase ventilation to restore methane to <10% LEL
Carbon Dioxide	>0.5%	Ventilate to restore carbon dioxide to <0.5%
	>1.5%	Stop works;
		Evacuate personnel / prohibit entry;
		Increase ventilation to restore carbon dioxide to <0.5%

APPENDIX K UPDATED ENVIRONMENTAL MITIGATION IMPLEMENTATION SCHEDULE

APPENDIX K – Updated Environmental Mitigation Implementation Schedule (During Construction Phase)

Type of Impact	Recommended Mitigation Measures	Status
Air Quality	Dust mitigation measures stipulated in <i>the Air Pollution Control (Construction Dust) Regulation</i> shall be incorporated to control dust emission. Notice shall be given to authority prior to commencing of work	V
Noise	Use of quiet PME	N/A
	 Good Site Practice Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program; Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program; Mobile plant, if any, should be sited as far from NSRs as possible; Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities. 	V
Water Quality	The practices outlined in ProPECC PN 1/94 Construction Site Drainage should be adopted to minimize the potential water quality impacts from construction site runoff and various construction activities. The recommendation to install perimeter drains to collect site runoff and to properly treat the runoff by settlement tank/treatment system shall apply to all sites including those for mainlaying works. Minimum distances of 100 m should be maintained between the discharge points of construction site runoff and the existing WSD saltwater intake at Tai Po.	٧
	A discharge licence needs to be applied from EPD for discharging effluent from the construction site. The discharge quality is required to meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies with all the standards listed in the TM. Reuse and recycling of the treated effluent can minimize water consumption and reduce the effluent discharge volume. The beneficial uses of the treated effluent may include dust suppression, wheel washing and general cleaning. Monitoring of the discharge quality of treated effluent should be part of the Environmental Monitoring and Audit (EM&A) programme. Detailed effluent sampling programme for water quality control during construction phase should be submitted to EPD, AFCD and WSD for approval prior to commencement of the construction works.	V
	The construction programme should be properly planned to minimize soil excavation, if any, in rainy seasons. This prevents soil erosion from exposed soil surfaces. Any exposed soil surfaces should also be properly protected to minimize dust emission. In areas where a large amount of exposed soils exist, earth bunds or sand bags should be provided. Exposed stockpiles should be covered with tarpaulin or impervious sheets at all time. The stockpiles of materials should be placed in the locations away from any stream courses so as to avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted and protected by permanent work. It is suggested that haul roads should be paved with concrete and the temporary access roads are protected using crushed stone or gravel, wherever practicable. Wheel washing facilities should be provided at all site exits to ensure that earth, mud and debris would not be carried out of the works areas by vehicles.	V
	Good site practices should be adopted to clean the rubbish and litter on the construction sites so as to prevent the rubbish and litter from dropping into the nearby environment. It is recommended to clean the construction sites on a regular basis.	V

Type of Impact	Recommended Mitigation Measures	Status
	It is recommended to provide sufficient chemical toilets in the works areas. The toilet facilities should not be less than 30 m from any watercourse. A licensed waste collector should be deployed to clean the chemical toilets on a regular basis. The construction workers can also make use of the existing toilet facilities within the TPSTW as necessary.	√
	Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the project. Implementation of environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site.	V
	It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	V
	Any service shop and minor maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken with the areas appropriately equipped to control these discharges.	V
	Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows: • Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport • Chemical waste containers should be suitably labelled to notify and warn the personnel who are handling the wastes to avoid accidents. • Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area.	V
	Marine water quality monitoring should be carried out under emergency condition or during maintenance of the THEES tunnel to verify the findings of the water quality modelling. It is recommended that the maintenance of the THEES tunnel, if unavoidable, should be conducted during winter season or low flow periods and to avoid the "blooming" season of algae (normally from April to June) if practicable. Details of the monitoring requirements are specified in the EM&A Manual.	N/A

Type of Impact	Recommended Mitigation Measures	Status
Waste	Good site practices during the construction activities include:	
Management	Nomination of approved personnel, such as a site manager, to be responsible for good site	
	practices, arrangements for collection and effective disposal to an appropriate facility, of all	
	wastes generated at the site.	
	Training of site personnel in proper waste management and chemical waste handling procedures.	
	Provision of sufficient waste disposal points and regular collection for disposal.	
	Appropriate measures to minimise windblown litter and dust during transportation of waste by	
	either covering trucks or by transporting wastes in enclosed containers.	
	Separation of chemical wastes for special handling and appropriate treatment at the Chemical Waste Treatment Facility	
	 Waste Treatment Facility. Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors. 	
	A Waste Management Plan shall be prepared and this WMP shall be submitted to the Engineer	
	for approval. One may make reference to ETWB TCW No. 15/2003 for details.	
	In order to monitor the disposal of C&D materials at landfills and public filling areas, and to	
	control fly tipping, a trip-ticket system shall be included as one of the contractual requirements	
	and implemented by an Environmental Team undertaking the Environmental Monitoring and	
	Audit work. One may make reference to WBTC No. 21/2002 for details.	
	A recording system for the amount of wastes generated, recycled and disposed (including the	
	disposal sites) shall be proposed.	
	Waste reduction is best achieved at the planning and design stage, as well as by ensuring the	√
	implementation of good site practices. Recommendations to achieve waste reduction include:	
	Segregation and storage of different types of waste in different containers, skips or stockpiles to	
	enhance reuse or recycling of materials and their proper disposal.	
	To encourage collection of aluminum cans by individual collectors, separate labelled bins shall be	
	provided to segregate this waste from other general refuse generated by the work force.	
	Any unused chemicals or those with remaining functional capacity shall be recycled.	
	Maximize the use of reusable steel formwork to reduce the amount of C&D material.	
	• Prior to disposal of C&D waste, it is recommended that wood, steel and other metals shall be	
	separated for re-use and / or recycling to minimize the quantity of waste to be disposed of to	
	landfill.	
	Proper storage and site practices to minimize the potential for damage or contamination of construction materials.	
	Plan and stock construction materials carefully to minimize amount of waste generated and avoid	
	unnecessary generation of waste.	
	Minimize over ordering of concrete, mortars and cement grout by doing careful check before	
	ordering	
	General Refuse	V
	General refuse shall be stored in enclosed bins or compaction units separate from C&D material. A	
	reputable waste collector shall be employed by the contractor to remove general refuse from the site,	
	separately from C&D material. An enclosed and covered area is preferred to reduce the occurrence	
	of 'wind blown' light material.	
	G A D Ivi (GAD) W I	1
	Construction & Demolition (C&D) Material	$\sqrt{}$
	C&D material generated from the site formation and demolition works shall be sorted on-site into	
	inert C&D material (i.e. public fill) and C&D waste. In order to minimise the impact resulting from	
	collection and transportation of C&D material for off-site disposal, the excavated material	
	comprising fill material shall be reused on-site as backfilling material as far as practicable. C&D waste, such as wood, plastic, steel and other metals shall be reused or recycled and, as a last resort,	
	disposed of to landfill. A suitable area shall be designated within the site for temporary stockpiling of	
	C&D material and to facilitate the sorting process.	
	The state of the finance the sorting process.	

Type of Impact	Recommended Mitigation Measures				
	Bentonite Slurry Bentonite slurries used in construction works should be reconditioned and reused wherever practicable. Residual used bentonite slurry should be disposed of from the site as soon as possible. The Contractor should explore alternative disposal outlets for the residual used bentonite slurry and disposal at landfill should be the last resort.	N/A			
Landfill Gas Hazard	All personnel who work on the site and all visitors to the site should be aware of the possibility of ignition of gas in the vicinity of excavations. Safety notices should be displayed at prominent position around the site. Adequate fire extinguisher equipment and fire resistant clothing should be made available on site.	V			
	Service runs within the consultation zone should be designated as "special routes" and utilities companies should be informed of this and should implement precautionary measures.	V			
	Precautionary measures to minimize landfill gas hazard during excavation: No smoking or burning shall be allowed No worker shall work alone at any time in the confined space or any excavation trenches Construction equipment shall be equipped with a vertical exhaust at least 0.6 m above ground level and /or with a park arrestors Electrical motors and electrical extension cords shall be explosive-proof or intrinsically safe Permit to Work procedures to be adopted for welding, flame cutting or other hot works in trenches or confined spaces Forced ventilation if working in a trench deeper than 1 m Close all valves immediately after piping assembly or conduiting construction. For the large diameter pipes, pipe end shall be capped on one side. Forced ventilation shall also be provided before commissioning of the pipeline and staff entering and working in it Routine monitoring shall be conducted in all excavations to ensure the works area to be free of landfill gas before any man enters the area. Landfill gas precautionary measures involved with excavation and piping works shall be included in the Safety Plan Monitoring shall be conducted at the cracks on the ground floor during ground-works construction	1			
	 Where there are any temporary site offices, or any other buildings which have enclosed spaces with the capacity to accumulate landfill gas, then they should either: be located on an area which has been proven to be free of landfill gas (by survey with portable gas detectors) and monitored manually by the Safety Officer or an approved wand appropriately qualified person to ensure that hazardous concentration of landfill gas does not occur; or be raised clear of the ground. If buildings are raised clear of the ground, a minimum, clear separation (as measured from the highest point on the ground surface to the underside of lowest floor joist) should be 500mm 	1			

 $\begin{tabular}{ll} \textbf{Note}: \\ $\sqrt{ } & - Compliance of mitigation measures \\ $X $ & - Non-compliance of mitigation measures \\ $N/A - Not applicable \end{tabular}$

APPENDIX L WASTE GENERATION IN THE REPORTING MONTH

APPENDIX L - WASTE GENERATION IN THE REPORTING MONTH

Monthly Summary Waste Flow Table August 2010 (Year)

		Actual Quantities of Inert C&D Materials Generated Monthly				Actual Quantities of C&D Wastes Generated Monthly					
Month	Total Quantity Generated	Broken Concrete (see Note 3)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastic (see Note 2)	Chemical Waste	Others, e.g. general refuse
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m3)
Jan											
Feb											
Mar											
Apr											
May											
June											
Sub-total											
July	3.11	0	0	0	3.11	0	0	0	0	0	0.01
Aug	0.04	0	0	0	0.04	0	0	0	0	0	0
Sept											
Oct											
Nov											
Dec											
Total	3.15	0	0	0	3.15	0	0	0	0	0	0.01

Notes:

- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
- (3) Broken concrete for recycling into aggregates.

APPENDIX M COMPLAINT LOG


APPENDIX M - COMPLAINT LOG


Reporting Month: August 2010


Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
N/A	N/A	N/A	N/A	N/A	N/A


Remarks: No environmental complaint was received in the reporting month.


APPENDIX N CONSTRUCTION PROGRAMME

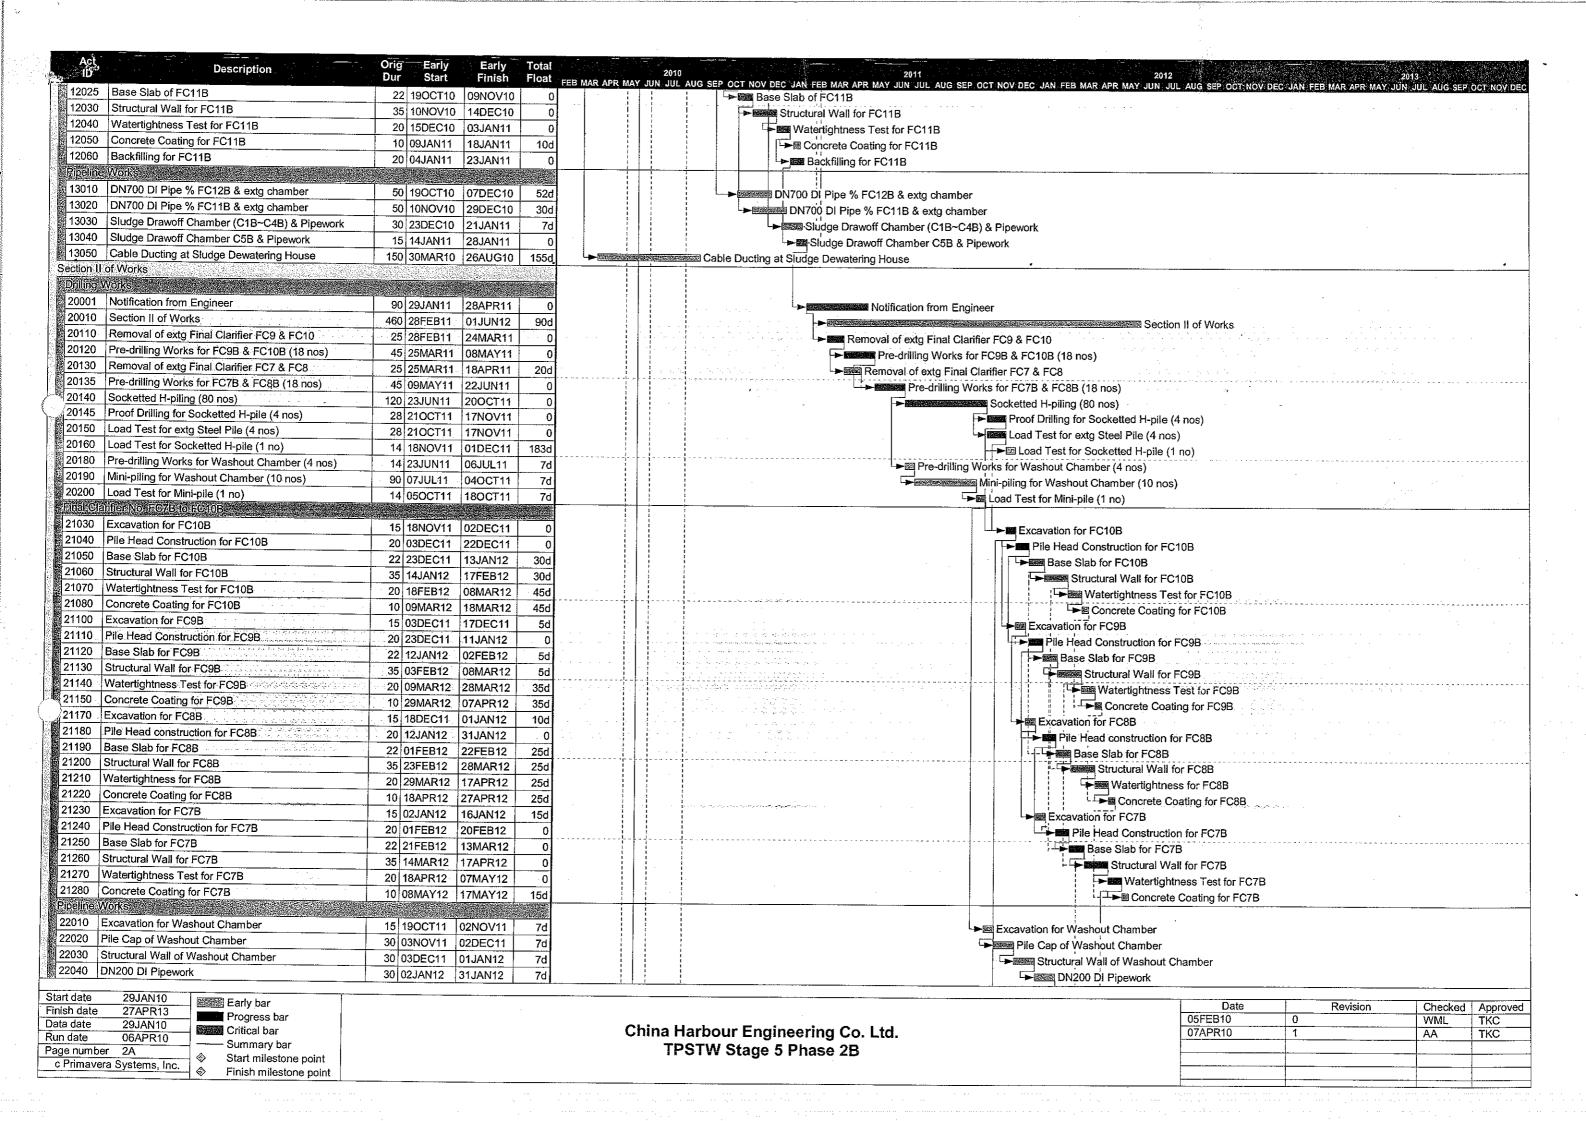

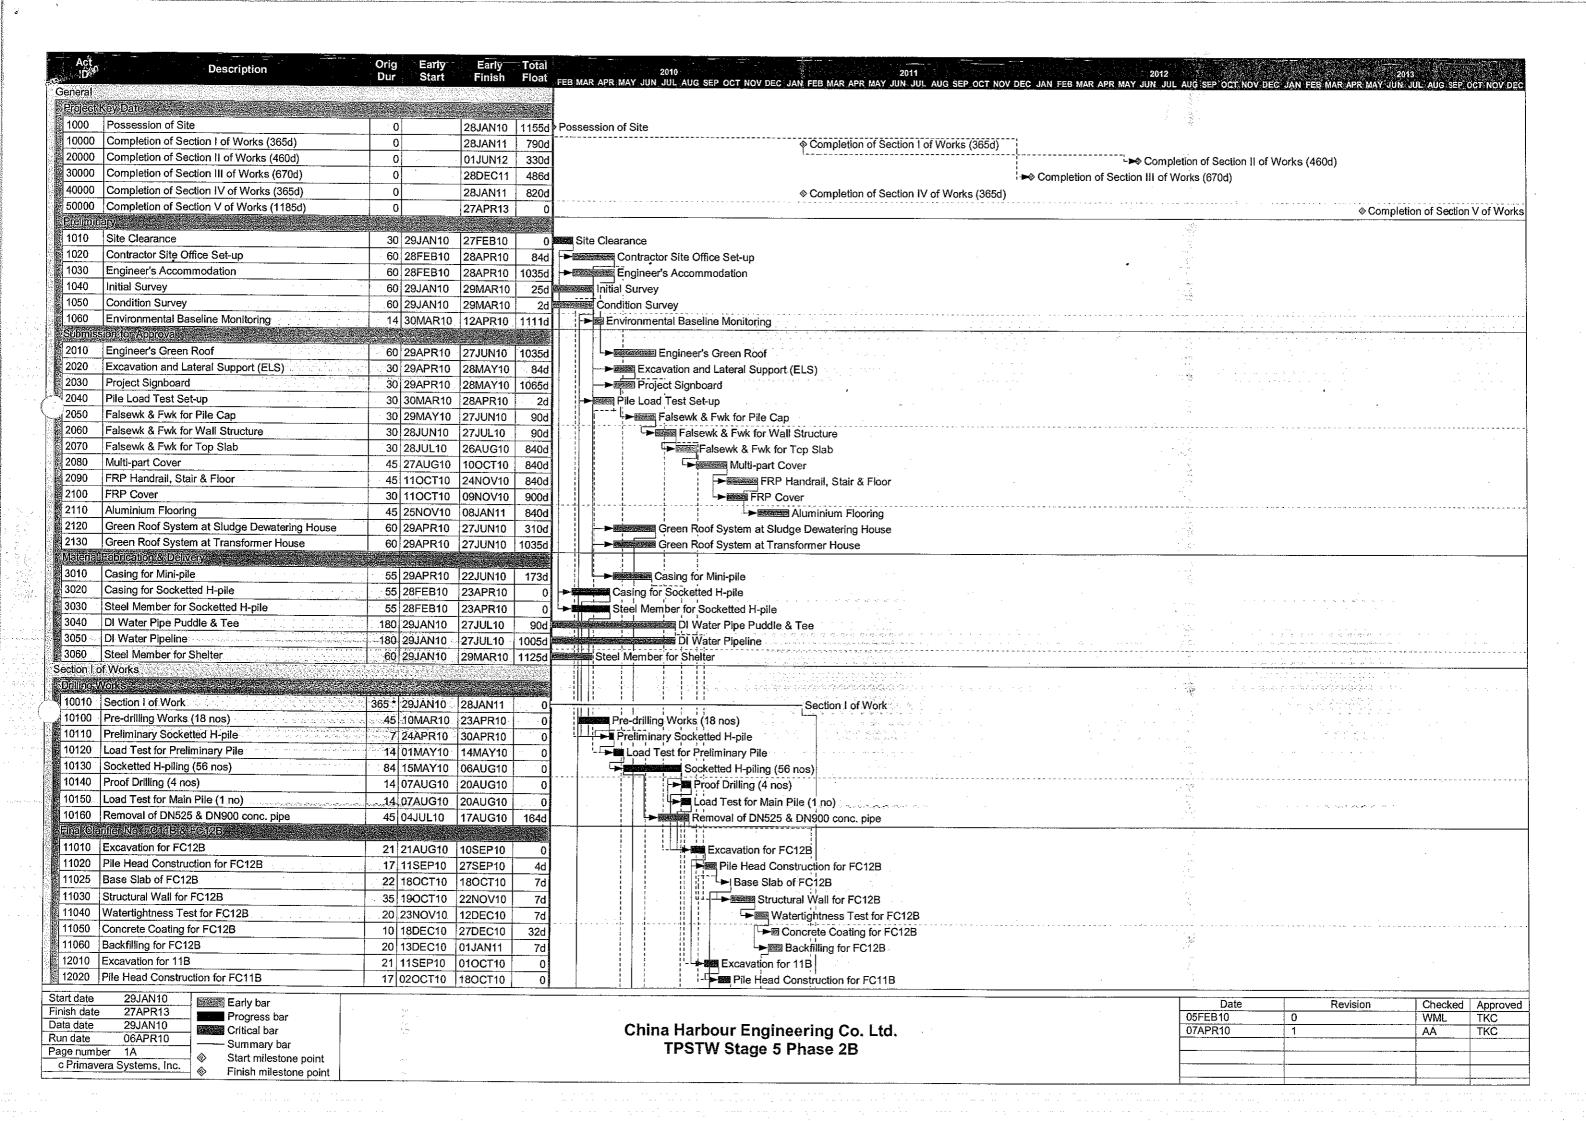

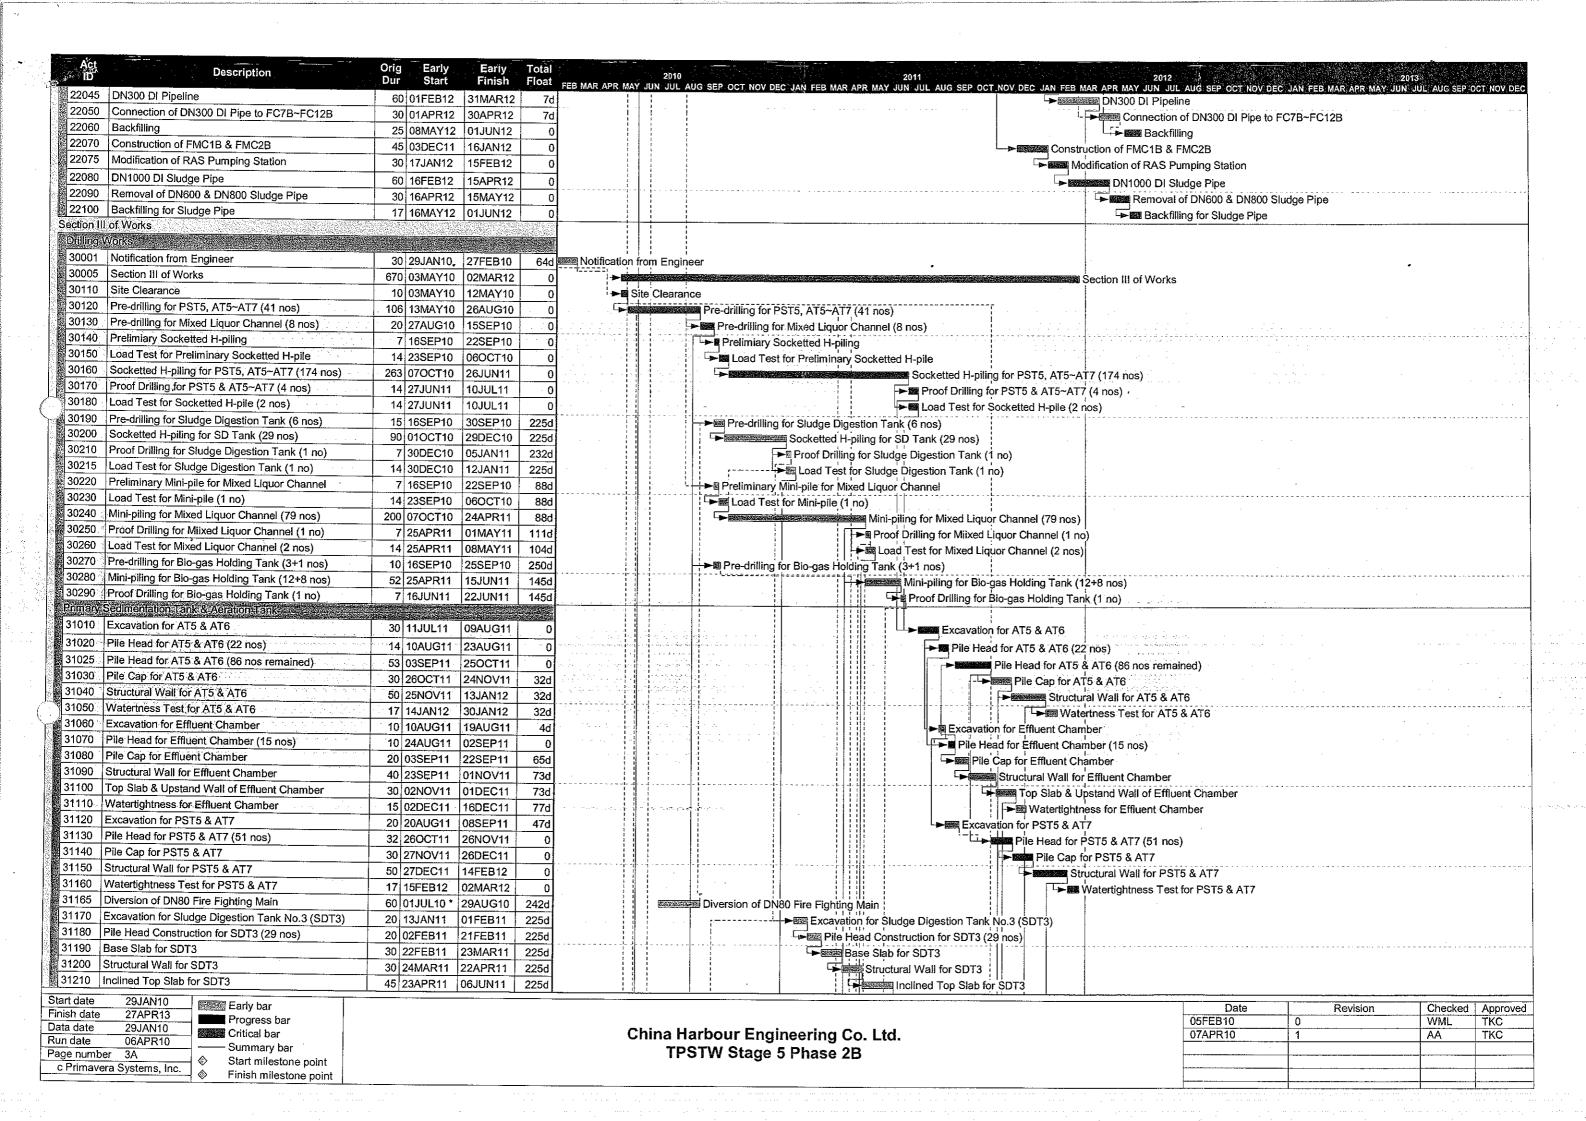

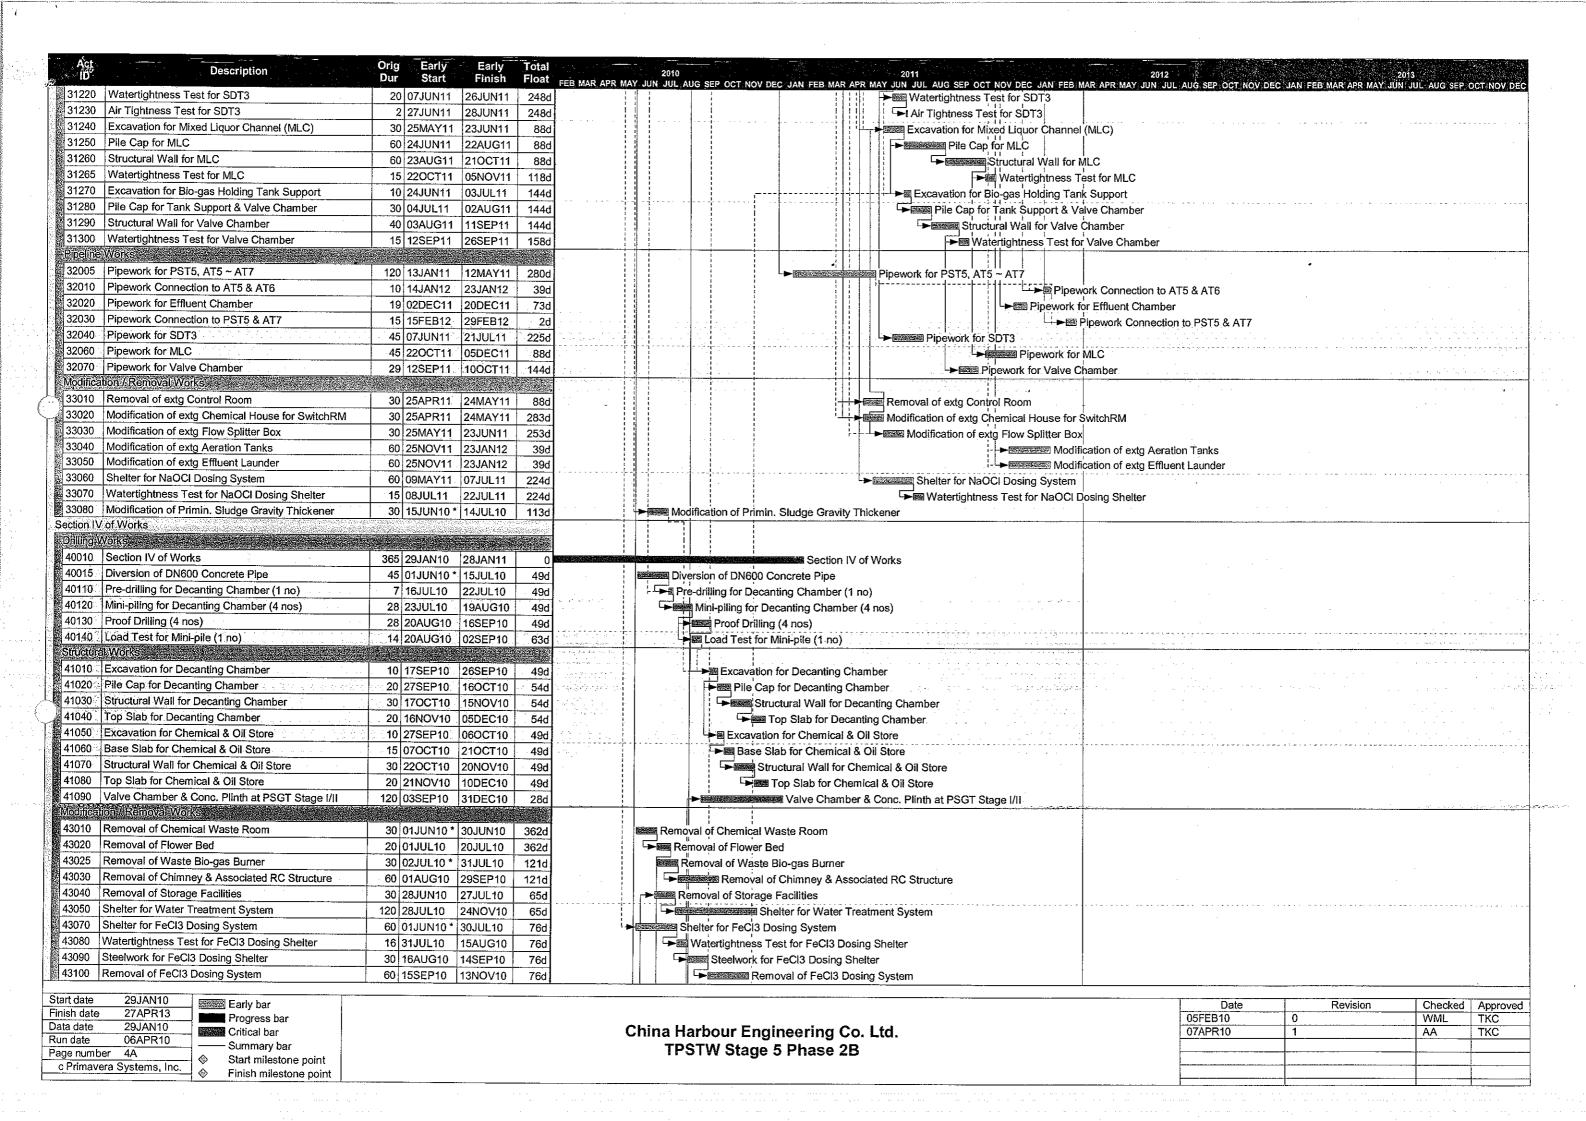

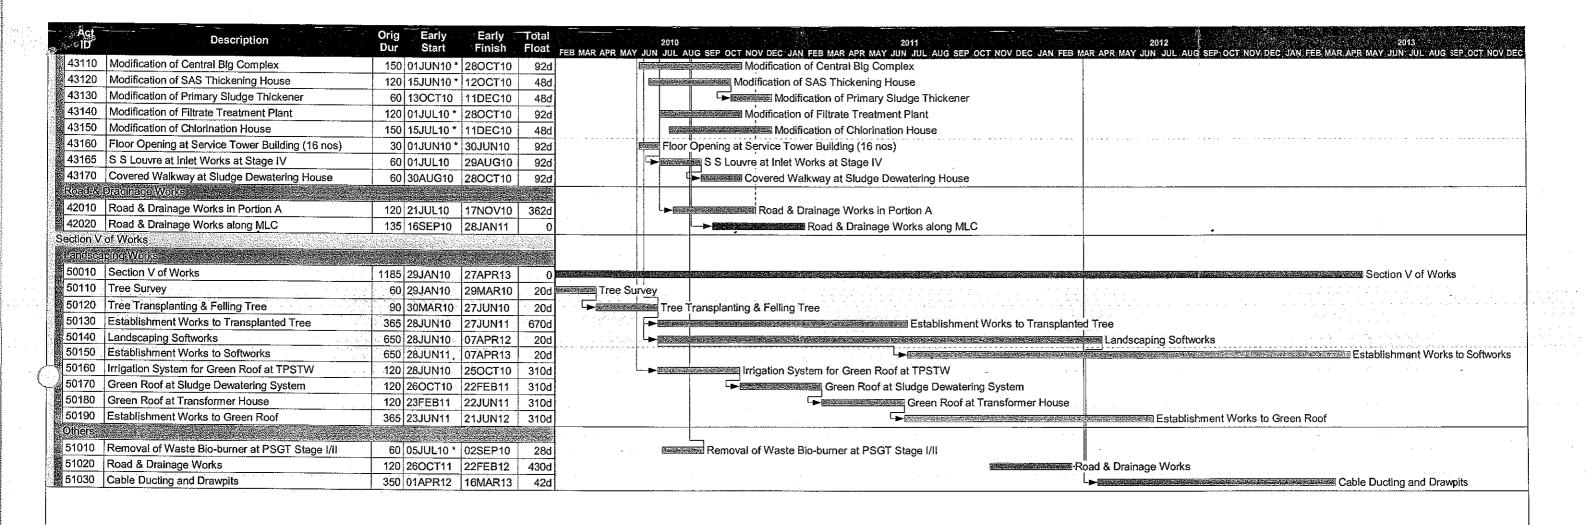

	L.			
İ	Start date	29JAN10	Earl	v har
	Finish date	27APR13	Proc	•
-	Data date	29JAN10	Criti	
ĺ	Run date	06APR10		mary bar
	Page number	5A		•
	c Primavera	Systems, Inc.		t milestone point
- 1		·	Finis	th milestone point

China Harbour Engineering Co. Ltd. TPSTW Stage 5 Phase 2B

Date	Revision	Checked	Approved
05FEB10	0	WML	TKC
07APR10	1	AA	TKC