

東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong  
Tel : 2695 8318 E-mail : etl@ets-testconsult.com  
Fax : 2695 3944 Web site : www.ets-testconsult.com

**TEST REPORT**

**China Harbour – China State Joint Venture**

**CONTRACT NO. CV/2009/02**  
**HANDLING OF SURPLUS PUBLIC FILL**  
**TSEUNG KWAN O AREA 137 FILL BANK**  
**MONTHLY EM&A REPORT NO.48**  
**(NOVEMBER 2013)**

Prepared by:

  
LAW, Sau Yee  
Senior Environmental Officer

Checked by:

  
LAU, Chi Leung  
Environmental Team Leader

Issue Date: 07 December 2013

Report No.: ENA32168

Ref.: CEDPFRSFEM00\_0\_1539L.13

11 December 2013

By E-mail and Fax No.: 2695 3944

ETS-Testconsult Limited  
8/F, Block B  
Veristrong Industrial Centre  
34-36 Au Pui Wan Street  
Fo Tan, Hong Kong

Attention: Mr. C. L. Lau

Dear Mr. Lau,


**Re: Contract No. CV/2009/02  
Handling of Surplus Public Fill – Tseung Kwan O Area 137 Fill Bank  
Monthly EM&A Report No. 48 for November 2013**

Reference is made to your submission of the draft Monthly EM&A Report for November 2013 for the captioned by E-mail on 7 December 2013 and the subsequent revision on 11 December 2013.

We are pleased to inform you that we have no comment on the captioned report.

Thank you very much for your attention and please do not hesitate to contact our Jason Lai or the undersigned should you have any queries.

Yours sincerely,



Tony Cheng  
Independent Environmental Checker

c.c. CEDD  
CHCSJV

Attn: Mr. Jason Wong / Mr. Terry Chock  
Attn: Mr. Dennis Tang

Fax No.: 2714 0113  
Fax No.: 2247 4108

Q:\Projects\CEDPFRSFEM00\Corr\CEDPFRSFEM00\_0\_1539L.13.doc



<b>TABLE OF CONTENTS</b>		<b>Page</b>
<b>EXECUTIVE SUMMARY</b>		
<b>1.0</b>	<b>INTRODUCTION</b>	1
<b>2.0</b>	<b>PROJECT INFORMATION</b>	
	2.1 Scope of the Project	1
	2.2 Site Description	2
	2.3 Work Programme	2
	2.4 Project Organization and Management Structure	2
	2.5 Contact Details of Key Personnel	2
<b>3.0</b>	<b>WORK PROGRESS IN THIS REPORTING MONTH</b>	2
<b>4.0</b>	<b>AIR QUALITY MONITORING</b>	
	4.1 Monitoring Requirement	2
	4.2 Monitoring Equipment	2 – 3
	4.3 Monitoring Parameters, Frequency and Duration	3
	4.4 Monitoring Locations and Schedule	3
	4.5 Monitoring Methodology	3 – 4
	4.6 Action and Limit levels	4
	4.7 Event-Action Plans	4
	4.8 Results and Observation	4 – 5
<b>5.0</b>	<b>NOISE MONITORING</b>	
	5.1 Monitoring Requirements	6
	5.2 Monitoring Equipment	6
	5.3 Monitoring Parameters, Duration and Frequency	6
	5.4 Monitoring Locations and Period	6
	5.5 Monitoring Procedures and Calibration Details	6 – 7
	5.6 Action and Limit levels	7
	5.7 Event-Action Plans	7
	5.8 Results and Observation	7
<b>6.0</b>	<b>MARINE WATER QUALITY MONITORING</b>	
	6.1 Monitoring Requirements	7
	6.2 Monitoring Locations	8
	6.3 Monitoring Parameters	8
	6.4 Monitoring Frequency	8
	6.5 Monitoring Methodology and Equipment Used	8 – 10
	6.6 Action and Limit Level	10
	6.7 Event and Action Plan	10
	6.8 Monitoring Duration and Period in this reporting month	10
	6.9 Marine Water Monitoring Results	11
<b>7.0</b>	<b>IEC SITE AUDIT AND WEEKLY ET SITE INSPECTIONS</b>	
	7.1 IEC site Audits	11
	7.2 Weekly ET Site Inspections	12
	7.3 Review of Environmental Monitoring Procedures	12 – 13
	7.4 Assessment of Environmental Monitoring Results	13
	7.5 Advice on the Solid and Liquid Waste Management Status	13
<b>8.0</b>	<b>STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING</b>	13 – 14
<b>9.0</b>	<b>ENVIRONMENTAL NON-CONFORMANCE</b>	
	9.1 Summary of air quality, noise and marine water quality	14
	9.2 Summary of Environmental Complaints	14
	9.3 Summary of Notification of Summons and Prosecution	14
<b>10.0</b>	<b>IMPLEMENTATION STATUS</b>	
	10.1 Implementation Status of Environmental Mitigation Measures	14
	10.2 Implementation Status of Event and Action Plan	15
	10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling	15
<b>11.0</b>	<b>CONCLUSION AND RECOMMENDATIONS</b>	15 – 16
<b>12.0</b>	<b>FUTURE KEY ISSUE</b>	
	12.1 Work Programme for the Coming Month	16
	12.2 Key Issues for the Coming Month	16 – 17
	12.3 Monitoring Schedule for the Coming Month	17



## APPENDIX I

A	Organization Chart and Lines of Communication
B1	Calibration Certificates for Impact Air Quality Monitoring Equipment
B2	Impact Air Quality Monitoring Results
B3	Graphical Plots of Impact Air Quality Monitoring Data
C1	Calibration Certificates for Impact Noise Monitoring Equipment
C2	Impact Noise Monitoring Results
C3	Graphical Plots of Impact Noise Monitoring Data
D1	Calibration Certificates for Impact Marine Water Quality Monitoring Equipment
D2	Impact Marine Water Quality Monitoring Results
D3	Graphical Plots of Impact Marine Water Quality Monitoring Data
E	Weather Condition
F	Event-Action Plans
G	Work Programme
H	IEC's Site Audit Records
I	Weekly ET's Site Inspection Record
J	Implementation Schedule of Mitigation Measures
K	Site General Layout Plan
L	Monitoring Schedule for the Coming Month
M	Complaint Log

## APPENDIX I

### FIGURES

Figure 1	Water Quality Monitoring Stations
Figure 2	Noise Environmental Monitoring Station
Figure 3a	Locations of Air Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank

## APPENDIX II

Marine Water Quality Monitoring Report for Contract No. HY/2010/02 Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing Facilities – Reclamation Works

### TABLES

2.1	Contact Details of Key Personnel
4.1	Air Quality Monitoring Equipment
4.2	Monitoring parameters, duration and frequency of air quality monitoring
4.3	Air Quality Monitoring Locations
4.4	Action and Limit levels for 24-hr TSP and 1-hr TSP
4.5	Summary of 1-hr TSP and 24-hr TSP Monitoring Results
5.1	Noise Monitoring Equipment
5.2	Duration, Frequency and Parameters of noise monitoring
5.3	Noise Monitoring Locations
5.4	Action and Limit levels for noise monitoring
5.5	Summary of Impact Noise Level
6.1	Locations of Marine Water Monitoring Stations
6.2	Marine Water Quality Monitoring Parameters
6.3	Monitoring frequency of the marine water
6.4	Summary of testing procedures
6.5	Details of Marine Water Quality Monitoring Equipment (In-site measurement)
6.6	Water Quality Action and Limit Levels
6.7	Time Schedule of Impact Marine Water Quality Monitoring
6.8	Summary of Impact Marine Water Quality Exceedances in this reporting month
7.1	Dates of IEC Site Audits in this reporting month
7.2	Key Findings of IEC Site Audits in this reporting month
7.3	Key Findings of Weekly ET Site Audits in this reporting month
7.4	Actual amounts of Waste generated in this reporting month
8.1	Summary of environmental licensing and permit status
10.1	Summary of Environmental Complaints and Prosecutions





## **EXECUTIVE SUMMARY**

This monthly Environmental Monitoring and Audit (EM&A) report No.48 was prepared by ETS-Testconsult Ltd (ET) for the "Contract No: CV/2009/02 – Handling of Surplus Public Fill – Tseung Kwan O Area 137 Fill Bank" (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 in November 2013.

### **Site Activities**

As informed by the Contractor, the site activities in this reporting month were as below:

- Removal & delivery of public fill stockpiled material to Mainland
- Operation of the road water lorries and the road sweeper
- Repair of Silt Curtain;
- Delivery of public fill received at the Chai Wan Public Fill Barging Point to TKO fill bank
- Operation of the tipping hall (A2 & A3)
- Operation at the queuing area for public truck lorries

### **Environmental Monitoring Progress**

The summary of the monitoring activities in this monitoring month is listed below:

- Noise Monitoring (Day-time): 1 Occasion at 1 designated location
- 24-hour TSP Monitoring: 5 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 15 Occasions at 2 designated locations
- Marine Water Quality Monitoring: 13 Occasions at 2 designated locations
- Weekly-site inspection: 4 Occasions

### **Noise Monitoring**

No exceedance of Action and Limit levels for noise monitoring was recorded in the reporting month.

### **Air Monitoring**

Since the old CREO was closed, dust monitoring station TKO-A2 located at old Combined Reception and Exit Office (CREO) was relocated to the new dust monitoring station TKO-A2a at the new CREO under the proposal by ET, approval by the ER and agreement by IC(E) and effective on 01 February 2011.

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting month.

### **Marine Water Quality Monitoring**

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded in this reporting month.

### **Site Inspection**

Environmental site inspections conducted in this reporting month are presented as follows:

<u>Concerned Parties</u>	<u>Dates of Audit / Inspection</u>
ET Weekly site inspection	06, 13, 20 and 25 November 2013
IEC site inspection	06 and 25 November 2013

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting month. The major findings observed during site inspections are presented in the Section 7.0.

### **Landscape and Visual**

The germination rate on the panels was satisfactory in this reporting month. The Contractor should properly maintain the hydroseeded panels.

### **Environmental Complaints, Notification of summons and successful prosecutions**

No complaints and no notification of summons or successful prosecutions with respect to environmental issues were received in this reporting month.



### **Future Key Issues**

Based on the site inspections and forecast of engineering works in the coming month, key issues to be considered are as follows:

- *Noise and air quality impact due to site works;*
- *Maintain wheel washing facilities properly;*
- *Maintain all drainage and desilting facilities properly;*
- *Use and maintain silt curtain properly;*
- *Clean up the fill material on concrete pavement along the BHA frequently;*
- *Watering, hydroseeding or covering all opening slopes and stockpiles with tarpaulin to avoid wind and water erosion;*
- *Sufficient drip trays for all oil drums / chemical containers;*
- *Implement all necessary preventive measures to avoid oil leakage. In the event an oil leakage happens, the Contractor should properly remove the leaked oil and handle the contaminated soil and all materials using for this cleaning works as chemical waste;*
- *Maintain good site practice and waste management to minimize environmental impacts at the site; and*
- *Follow-up improvements on waste management issues.*



## 1.0 INTRODUCTION

China Harbour – China State Joint Venture (CHCSJV) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the “Contract No: CV/2009/02 –Handling of Surplus Public Fill – Tseung Kwan O Area 137 Fill Bank” (The Project).

In accordance with the Environmental Permit (No.: EP-134/2002/K) (the EP), an EM&A programme should be implemented in accordance with the procedures and requirements in the EM&A Manual of the approved EIA report (Registration No. AEIAR-060/2002). The EM&A programme for this study as stated in Section 2.3.1 of the EM&A Manual covers the following environmental aspects during the establishment, operation and removal phases of the Fill Bank at Tseung Kwan O Area 137:

- *Fugitive Dust;*
- *Noise generation from onsite activities;*
- *Water Quality; and*
- *Landscape and Visual.*

The EM&A programme requires environmental monitoring for air quality, noise and water quality and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- *All monitoring parameters;*
- *Monitoring schedules for the reporting month and forthcoming months;*
- *Action and Limit levels for all environmental parameters;*
- *Event/Action Plans;*
- *Environmental mitigation measures, as recommended in the Project EIA study final report; and*
- *Environmental requirements in contract documents.*

Baseline monitoring was completed in August and September 2002 by MaterialLab. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 in November 2013.

## 2.0 PROJECT INFORMATION

### 2.1 Scope of the Project

The scale and scope of the Project as stated in the EP include:

- Site clearance;
- Construction of a temporary storm water system;
- Stockpiling of 6 million m<sup>3</sup> of public fill;
- Setting up two barging points: one at the Tseung Kwan O Basin (TKO Basin) and one at the Construction and Demolition Material Sorting Facility (C&DMSF) for transporting the stockpiled public fill by barges;
- Setting up a temporary barging point at the existing Explosive Off-loading Barging Point located in the south-eastern part of Area 137 for the period of May 2004 to December 2004 for transporting the stockpiled public fill by barge;
- Construction and operation of a Construction and Demolition Material Sorting Facility (C&DMSF);
- Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin; and
- Remove the temporary fill bank.



## 2.2 Site Description

Tseung Kwan O Area 137 is located at the southern end of Wan Po Road. In the vicinity of the site are other industrial uses such as SENT landfill, TKO Industrial Estate, etc. Both Island Resort and Fullview Garden are also situated at more than 1.8km from the site. Other existing ASRs and NSRs, including resident developments and schools, are located at a further distance away from TKO Area 137.

## 2.3 Work Programme

Details of work programme are shown in Appendix I G.

## 2.4 Project Organization and Management Structure

The organization chart and lines of communication with respect to the on-site environmental management and monitoring program are shown in Appendix I A.

## 2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Mr. Lawrence Ng Mr. Liu Chi Yuen Mr. Liu Kai Chun Mr. Wong Kai Chung Mr. C T Chock	Engineer's Representative	2762 5545	2714 0113
IEC (Materialab) *	Mr Joseph Poon	IEC	2450 8238	2450 6138
IEC (ENVIRON) *	Mr Tony Cheng	IEC	3465 2888	3465 2899
Contractor (CHCSJV)	Mr. Wah Fung Lok	Contractor's Agent	9772 7055	2243 4089
ET (ETL)	Mr C. L. Lau	ET Leader	2946 7791	2695 3944

Remark (\*): Materialab was being as IEC of this Project until 31 January 2010 and was replaced by ENVIRON from 01 February 2010

## 3.0 WORK PROGRESS IN THIS REPORTING MONTH

As informed by the Contractor, the activities in the reporting month include:

- Removal & delivery of public fill stockpiled material to Mainland
- Operation of the road water lorries and the road sweeper
- Repair of Silt Curtain
- Delivery of public fill received at the Chai Wan Public Fill Barging Point to TKO fill bank
- Operation of the tipping hall (A1, A2 & A3)
- Operation at the queuing area for public truck lorries

## 4.0 AIR QUALITY MONITORING

### 4.1 Monitoring Requirement

TSP levels were monitored in the reporting month in accordance with the EM&A Manual. Table 4.4 shows the Action and Limit Levels for the environmental monitoring works.

### 4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificates for the HVS and calibrator are attached in Appendix I B1.

Table 4.1 Air Quality Monitoring Equipment

<i>Equipment</i>	<i>Model and Make</i>
HVS	Greasby GMWS2310
Calibrator	Tisch TE-5025A

#### 4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequency of air quality monitoring

<i>Parameter</i>	<i>Duration</i>	<i>Frequency</i>
24-hr TSP	24 hr	Once every six days
1-hr TSP	1 hr	Three times per day every six days

#### 4.4 Monitoring Locations

Since the old CREO was closed, dust monitoring station TKO-A2 located at old Combined Reception and Exit Office (CREO) was relocated to the new dust monitoring station TKO-A2a at the new CREO under the proposal by ET, approval by the ER and agreement by IC(E) and effective on 01 February 2011.

Table 4.3 tabulates the air quality monitoring locations of this project.

Table 4.3 Air quality monitoring locations

<i>Monitoring station</i>	<i>Location</i>
TKO-A1	Site Egress
TKO-A2a	New CREO

#### 4.5 Monitoring Methodology

##### **Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)**

##### Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

##### Installation

The installation of HVS refers to the requirement stated in EM&A Manual.

##### Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 0.6m<sup>3</sup>/min and 1.7m<sup>3</sup>/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The flow rate was indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (GA-55) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.

- The programmable timer will be set for a sampling period of 1 hour or 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recorded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of  $25^{\circ}\text{C} \pm 3^{\circ}\text{C}$  and the relative humidity (RH)  $<50\% \pm 5\%$ .
- All measurement procedures in Section 2.3 of the EM&A Manual were followed during the reporting month.

#### Maintenance & Calibration

- HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

#### **Wind Data Monitoring**

Wind data (wind speed and wind direction) were directly extracted from Tseung Kwan O Station of Hong Kong Observatory. All wind data during this reporting month are shown in Appendix I E.

#### **4.6 Action and Limit Levels**

Table 4.4 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Table 4.4 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring Location	24-hr TSP ( $\mu\text{g}/\text{m}^3$ )		1-hr TSP ( $\mu\text{g}/\text{m}^3$ )	
	Action Level	Limit Level	Action Level	Limit Level
TKO-A1	210	260	376	500
TKO-A2 & TKO-A2a *	210	260	376	500

Remark (\*): Since dust monitoring stations TKO-A2 and TKO-A2a are located close to the major dust emission sources and also close to the same sensitive receptor and no significant difference between them on the prevailing meteorological conditions, the baseline data from TKO-A2 can also be valid in the case of TKO-A2a.

#### **4.7 Event-Action Plans**

Please refer to Appendix I F for details.

#### **4.8 Results and Observation**

##### **4.8.1 1-hour and 24-hour TSP Monitoring results**

Monitoring data of both 1-hour and 24-hour TSP monitoring carried out in this reporting month are summarized in Appendix I B2. Graphical presentation of 1-hour and 24-hour TSP monitoring results for the reporting month is shown in Appendix I B3. Wind data included wind speed and wind direction was extracted from Tseung Kwan O Station of Hong Kong Observatory during this reporting month and is presented in Appendix I E. Table 4.5 summarizes 1-hr TSP and 24-hr TSP monitoring results.



Table 4.5 Summary of 1-hr TSP and 24-hr TSP Monitoring Results

Air quality monitoring Stations	Location	Monitoring Period						
		24-hr TSP			1-hr TSP			
		Date	Result ( $\mu\text{g}/\text{m}^3$ )	Exceedance #	Date	Start Time	Result ( $\mu\text{g}/\text{m}^3$ )	Exceedance #
TKO-A1	Site Egress	05/11/13	192	X	01/11/13	13:00	321	X
					04/11/13	11:00	286	X
					06/11/13	09:35	203	X
		11/11/13	129	X	06/11/13	13:00	212	X
					08/11/13	09:00	227	X
					11/11/13	10:45	247	X
					13/11/13	13:00	259	X
					15/11/13	10:00	223	X
					18/11/13	13:52	200	X
		23/11/13	123	X	20/11/13	09:42	204	X
					22/11/13	13:50	217	X
					25/11/13	10:10	190	X
					25/11/13	13:00	217	X
					27/11/13	10:35	235	X
					29/11/13	10:45	220	X
TKO-A2a	New CREO	05/11/13	131	X	01/11/13	13:05	301	X
					04/11/13	10:55	295	X
					06/11/13	09:45	169	X
		11/11/13	100	X	06/11/13	13:00	185	X
					08/11/13	09:05	189	X
					11/11/13	10:40	206	X
					13/11/13	13:05	212	X
					15/11/13	10:05	189	X
					18/11/13	14:05	180	X
		23/11/13	102	X	20/11/13	09:55	191	X
					22/11/13	13:55	198	X
					25/11/13	10:15	177	X
					25/11/13	13:00	189	X
					27/11/13	10:30	214	X
					29/11/13	10:50	186	X

Remark (\*): L=Limit Level exceedance, A=Action Level exceedance and X=not an exceedance

No exceedance of Action and Limit Level of 1-hr TSP and 24-hour TSP monitoring results was recorded during the reporting month.

#### 4.8.2 Observation

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of the mist spraying systems at the CEDD Combined Reception Office and the site egress area, wheel washing facilities, road dampening by water bowsers and automatic water sprinklers on the main haul roads. Furthermore, hydroseeded slopes on the stockpiling areas was maintained properly in order to prevent dust generation from wind erosion of the exposed surfaces. Other dust sources near TKO Area 137 also included operation of the C&DMSF at the PBR2 Project site, the temporary C&DMSF at Portion K and dumping activities at the SENT Landfill.

## 5.0 Noise Monitoring

### 5.1 Monitoring Requirements

Noise monitoring was conducted at 1 monitoring station as specified in the approved EM&A Monitoring Proposal for good site practice. The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting month are presented in this section.

### 5.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level ( $L_{eq}$ ) and percentile sound pressure level ( $L_x$ ). It complies with International Electro Technical Commission Publications 651:1979 (Type1) and 804:1985 (Type1), and speed in m/s was used to monitor the wind speed.

Table 5.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix I C1.

Table 5.1 Noise Monitoring Equipment

<i>Equipment</i>	<i>Model</i>
<i>Sound Level Meter</i>	<i>Rion NL-31 / Rion NL-52</i>
<i>Sound Level Calibrator</i>	<i>Rion NC-73 / Castle GA607</i>

### 5.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 5.2.

Table 5.2 Duration, Frequencies and Parameters of Noise Monitoring

<i>Time period</i>	<i>Duration/min</i>	<i>Parameters</i>	<i>Frequency</i>
<i>Day-time: 0700-1900 hrs on normal weekday</i>	<i>30</i>	<i><math>L_{eq}</math>, <math>L_{10}</math>, <math>L_{90}</math></i>	<i>Once per month</i>

### 5.4 Monitoring Locations

One Noise monitoring was conducted at the noise monitoring location, TKO-N1 as shown in Figure 2 during the reporting month. Table 5.3 describes the location of the monitoring station.

Table 5.3 Noise Monitoring Locations

<i>Monitoring station</i>	<i>Location</i>	<i>Type of Measurement</i>
<i>TKO-N1</i>	<i>Outside site Egress along Wan Po Road</i>	<i>Free Field</i>

### 5.5 Monitoring Procedures and Calibration Details

#### Operation/Analysis Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - *Frequency weighting: A*
  - *Time weighting : Fast*
  - *Time measurement : 30 mins*
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.





- During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

**Maintenance and Calibration**

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

**5.6 Action and Limit Levels**

The Action and Limit levels for noise levels derived as illustrated in Table 5.4.

Table 5.4 Action and Limit Levels for noise monitoring

Time Period	Time Period	Action	Limit
Normal hours	0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)

**5.7 Event-Action Plans**

Please refer to the Appendix I F for details.

**5.8 Results and Observation**

**5.8.1 Results**

Only Day-time noise monitoring was carried out at monitoring station TKO-N1 in this reporting month. The detail of the noise monitoring is provided in Appendix I C2. Graphical presentation of the monitoring result for the reporting month is shown in Appendix I C3. A summary of the monitoring result is presented in Table 5.5.

Table 5.5 Summary of Impact Noise Level

Date	Start Sampling Time (hh:mm)	Noise Level dB (A) *		
		Leq(30min)	L10	L90
06/11/13	13:00	66.7	68.5	63.1

Remark: (\*): Correction factor of +3dB(A) was added to the measured results due to the free Field measurements.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedances were recorded. Besides, no exceedances in Limit Level were recorded according to the result from Day-time monitoring.

**5.8.2 Observation**

The major noise source during the monitoring event was the dump truck traffic. Operation of the Fill Bank was from 08:00 to 21:00 from Monday to Sunday in the reporting month. Whereas the operation hours for barge activities in the TKO Basin was from 08:00 to 21:00. The monitoring result complied with the noise limit of 75dB(A).

**6.0 MARINE WATER QUALITY MONITORING**

**6.1 Monitoring Requirements**

In accordance with the EM&A Manual, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at Control Station, C1 and Monitoring Station, M4.

## 6.2 Monitoring Locations

For the Reclamation Project, there were 4 Designated Monitoring Stations and 2 Designated Control Stations specified in the EM&A Manual. Upon the completion of the monitoring programme under Stage 2 reclamation works, the ET started monitoring events at the impact station M4 and the control station C1 from 18 May 2004 onwards. Figure 1 shows the location of the marine water quality monitoring stations. Table 6.1 describes the locations of the monitoring stations in the reporting month.

Table 6.1 Locations of Marine Water Monitoring Stations

Station Description	Code	HK Metric Grid E	HK Metric Grid N
Control Station (Ebb tide)	TKO-C1	844 740.208	815 371.502
Monitoring Station, Tung Lung Chau Fish Culture Zone	TKO-M4	847 741.029	812 977.878

## 6.3 Monitoring Parameters

Monitoring of the marine water quality parameters are listed in Table 6.2.

Table 6.2 Marine Water Quality Monitoring Parameters

In-situ measurement	Laboratory analysis
Depth (m)	Suspended solids (mg/L)
Temperature (°C)	
Dissolved Oxygen (mg/L and % saturation)	
Turbidity (NTU)	
Salinity (ppt)	

## 6.4 Monitoring Frequency

The monitoring frequency of the marine water monitoring is summarized in Table 6.3.

Table 6.3 Monitoring frequency of the marine water

Parameter	Frequency	No. of Location	No. of Depths
Temperate	3 days/week, 2 tides/day	2 (TKO-C1 and TKO-M4)	3 (Surface, mid-depth & bottom)
Salinity			
DO			
Turbidity			
Suspended solids			

## 6.5 Monitoring Methodology and Equipment Used

### For Location of the monitoring stations

#### **Global Positioning System (GPS)**

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

### For Water Depth measurement

#### **Echo Sounder**

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

### For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.



### **Dissolved Oxygen, Salinity and Temperature Measuring Equipment**

A portable, weatherproof dissolved oxygen & salinity measuring instrument, which complete with cable, sensor and DC power source (e.g. YSI 85 or equivalent) was used for measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200 % saturation;
- a salinity in range 0-40 ppt; and
- a temperature of 0-45 degree Celsius

A membrane electrode with automatic temperature compensation complete with a cable was installed.

### **Turbidity Measurement Instrument**

A portable and weatherproof turbidity meter (HACH model 2100P) was used during impact monitoring. It has a photoelectric sensor capable of measuring turbidity between 0-1000 NTU. Response of the sensor was checked with certified standard Turbidity solutions before the start of measurement.

### **For Water Sampling and Sample Analysis**

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. If the water depth is less than 6 m, the mid-depth station shall be omitted and if the water depth is below 3 m, only the mid depth station shall be monitored.

### **Water Sampler**

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.

### **Water Container**

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labelled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 6.4.

Table 6.4 Summary of testing procedures

<i>Laboratory Analysis</i>	<i>Testing Procedure</i>	<i>Detection Limit</i>
<i>Total suspended solids</i>	<i>In house method based on APHA 19<sup>th</sup> ed 2540D</i>	<i>1.0 mg/L</i>

### **In-situ measurement**

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before the start of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100P) after inserting the cell to the Turbidimeter. For DO, DOS and Salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required.

Table 6.5 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix I D1.




Table 6.5 Details of Marine Water Quality Monitoring Equipment (In-site measurement)

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	Garmin eTrex 10	-----	-----	ET/EW/005/04
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI Pro2030	29/10/13	28/01/14	ET/EW/008/004 *
Turbidity	HACH Model 2100Q Turbid Meter	08/10/13	07/01/14	ET/0505/009 *
Water Depth	Speedtech SM-5	-----	-----	ET/EW/002/06

Remark:(\*) indicates the instrument should be calibrated on use.

### 6.6 Action and Limit Level

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.

Table 6.6 Water Quality Action and Limit Levels

Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface &amp; Middle</u> <5.45 mg/L (5%-ile of baseline data) <u>Bottom</u> <4.72 mg/L (5%-ile of baseline data)	<u>Surface &amp; Middle</u> <5.10 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth-averaged)	>6.74 mg/L (95%-ile of baseline data) or >120% of the upstream control station's SS at the same tide on the same day	>7.67 mg/L (99%-ile of baseline data) or >130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth-averaged)	>4.28 NTU (95%-ile of baseline data) or >120% of the upstream control station's turbidity at the same tide on the same day	>4.58 NTU (99%-ile of baseline data) or >130% of the upstream control station's turbidity at the same tide on the same day

### 6.7 Event and Action Plan

Please refer to the Appendix I F for details.

### 6.8 Monitoring Duration and Period in this reporting month

Below is the time schedule for the marine water quality monitoring events that were conducted in this reporting month:

Table 6.7 Time Schedule of Impact Marine Water Quality Monitoring

November 2013						
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					1	2
3	4	5	6	7	8	9
10	11	12	13	14	15	16
17	18	19	20	21	22	23
24	25	26	27	28	29	30

Remarks: (▼) = Marine water quality monitoring carried out by ET.

The daily marine water quality monitoring duration are detailed in Appendix I D2.



## 6.9 Marine Water Quality Monitoring Results

The impact water quality measurement results are detailed in Appendix I D2. Appendix I D3 presents the water quality monitoring data and graphical presentations of monitoring results respectively.

The summary of marine water quality exceedances is shown in Table 6.8.

Table 6.8 Summary of Impact Marine Water Quality Exceedances in this reporting month

Station	Exceedance Level	DO		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
TKO-C1	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0
TKO-M4	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0

According to the summary of marine water monitoring results, no exceedance of Action and limit levels was recorded for this reporting month.

## 7.0 IEC SITE AUDIT AND WEEKLY ET SITE INSPECTIONS

### 7.1 IEC Site Audit

7.1.1 During this reporting period, the IEC team conducted two independent site audits of the Contract CV/2009/02 site (TKO Area 137 Fill Bank).

7.1.2 Findings of the site audit have been recorded on site checklists, copies of which were submitted to the Contractor for their further action as appropriate, and to the Client for their records. Key issues were highlighted to the Contractor's representative at the completion of each site audit to ensure that they were aware of the problem(s) identified and where necessary, to take immediate corrective actions. A copy of the completed checklists are appended to this report in Appendix I H.

Table 7.1 Dates of IEC Site Audits in this reporting month

Date of Audit	Work Period	Site Audit Checklist Submitted Under IEC's Ref No.
06 November 2013	Operation of TKO Area 137 Fill Bank	CEDPFRSFEM00_131106_TKOFB
25 November 2013		CEDPFRSFEM00_131125_TKOFB

7.1.3 The major findings recorded during the site audits conducted during this reporting period are summarized below. Full details are provided in the site audit checklists presented in Appendix I H.

Table 7.2 Key Findings of IEC Site Audits in this reporting month

Date	Key Findings	Action(s) Taken recommended by IEC	Action(s) Taken by the Contractor during the IEC audit	Rectification Status by IEC
06 November 2013	Housekeeping for chemical storage should be improved and kept tidy. (Previous item)	The Contractor was reminded to tidy up the chemical storage area.	Housekeeping for chemical storage had been improved.	Closed
	Silt curtain near the Tipping Hall No.1 was damaged. (New item).	The Contractor was reminded to replace the damaged silt curtain as soon as possible.	---	Follow-up
	Cladding of tipping hall No.2 was damaged (New item).	The Contractor was reminded to repair the damaged part of tipping hall.	---	Follow-up
25 November 2013	Silt curtain near the Tipping Hall No.1 was damaged. (Previous item).	The Contractor was reminded to replace the damaged silt curtain as soon as possible.	---	Follow-up
	Cladding of tipping hall No.2 was damaged (Previous item).	The Contractor was reminded to repair the damaged part of tipping hall.	---	Follow-up



## 7.2 Weekly ET Site Inspections

Weekly ET site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting month, four weekly site inspections were conducted (06, 13, 20 and 25 November 2013).

Table 7.3 Key Findings of Weekly ET Site Audits in this reporting month

Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor during the ET weekly site audit	Rectification Status by ET
06 November 2013	The floating booms of silt curtain near the tipping hall No.1 were found damaged. (Previous item)	To repair the silt curtain as soon as possible.	---	Follow-up
	Tipping hall No. 2 was found damaged. (Previous item)	To repair the tipping hall as soon as possible.	---	Follow-up
13 November 2013	The floating booms of silt curtain near the tipping hall No.1 were found damaged. (Previous item)	To repair the silt curtain as soon as possible.	---	Follow-up
	Tipping hall No. 2 was found damaged. (Previous item)	To repair the tipping hall as soon as possible.	---	Follow-up
20 November 2013	The floating booms of silt curtain near the tipping hall No.1 were found damaged. (Previous item)	To repair the silt curtain as soon as possible.	---	Follow-up
	Tipping hall No. 2 was found damaged. (Previous item)	To repair the tipping hall as soon as possible.	---	Follow-up
25 November 2013	The floating booms of silt curtain near the tipping hall No.1 were found damaged. (Previous item)	To repair the silt curtain as soon as possible.	---	Follow-up
	Tipping hall No. 2 was found damaged. (Previous item)	To repair the tipping hall as soon as possible.	---	Follow-up

Refer to EPD 's site visit on 01 November 2013, large amount of dust was emitted from various areas of the Fill Bank, in particular around the unloading area where the fill was unload to the barge. Due to this event, the Contractor has implemented control measures such as to water the working areas of the Fill Bank more frequency especially during dusty operation. The Contractor replied to take more effort to minimize the dust impact during dry weather. During the ET weekly site inspections on 06 and 13 November 2013, no fugitive dust emission was observed at working areas of the Fill Bank.

## 7.3 Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. The observations for the monitoring works were recorded and summarized as follows:

### Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.

### Noise Monitoring

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.



### **Water Quality Monitoring**

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.

## **7.4 Assessment of Environmental Monitoring Results**

All monitoring results were audited against the Action and Limit levels and any exceedance would be validated.

No exceedance was recorded in water quality, air quality and noise monitoring in this month.

The monitoring results in this reporting period were comparable with those of baseline period. Detailed discussions were given in Section 4, 5 and 6 of this Report.

## **7.5 Advice on the Solid and Liquid Waste Management Status**

The Contractor usually disposed of non-inert waste, including general refuse and materials segregated from the existing stockpiles, to SENT landfill. Table 7.4 summarizes data on offsite waste disposal in this reporting month.

Table 7.4 Actual amounts of Waste generated in this reporting month

<i>Waste Type</i>	<i>Actual Amount</i>	<i>Disposal Locations</i>
<i>Public Fill</i>	<i>0 m<sup>3</sup></i>	<i>---</i>
<i>C&amp;D Waste (general refuse)</i>	<i>0 m<sup>3</sup></i>	<i>---</i>
<i>Chemical Waste</i>	<i>0 kg</i>	<i>---</i>

The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.

Concrete bunding has erected outside the CEDD combined reception office and near the automatic wheel washing facilities for storing generator sets and oil drums. The drain outlet of all the banded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal were properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank, DP3 and DP4 and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.

All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

## **8.0 Status of Environmental Licensing and Permitting**

All permits/licenses valid in this reporting month are summarized in Table 8.1.



Table 8.1 Summary of environmental licensing and permit status

Description	Permit No.	Valid Period		Section
		From	To	
Amended Environmental Permit	EP-134/2002/K	04/02/13	---	<ul style="list-style-type: none"> <li>▪ Site clearance</li> <li>▪ Construction of a temporary storm water system</li> <li>▪ Stockpiling of 6 million m3 of public fill</li> <li>▪ Setting up two barging points for transporting the stockpiled public fill by barges</li> <li>▪ Setting up a temporary barging point at the existing Explosive Off-loading Barging Point for the period of May 2004 to December 2004 for transporting the stockpiled public fill by barge</li> <li>▪ Construction of operation of a construction and Demolition Material Sorting Facility (C&amp;DMSF)</li> <li>▪ Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin</li> <li>▪ Remove the temporary fill bank</li> </ul>
Chemical Waste Producer	5213-839-C3577-02	17/12/09	---	Spent Lubricating Oil, Spent Flammable Liquid, Spent Battery containing Heavy Metals and Surplus Paint
Effluent Discharge License	WT000057 77-2010	12/05/10	31/05/15	Wastewater arising from the wheel washing bay, Sedimentation Tank & Desilting Tank
Marine Dumping Permit	EP/MD/14-053	01/10/13	31/12/13	Approval for dumping 3,300,000 tons (approximately equal to 1,833,333 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan

## 9.0 ENVIRONMENTAL NON-CONFORMANCE

### 9.1 Summary of air quality, noise and marine water quality

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

### 9.2 Summary of Environmental Complaints

No complaint was received in this reporting month.

### 9.3 Summary of Notification of Summons and successful Prosecution

There was no notification of summons and successful prosecution respect to environmental issues registered in this reporting month.

## 10.0 IMPLEMENTATION STATUS

### 10.1 Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix J. Most of the necessary mitigation measures were implemented properly. Any deficiencies were noted in the remarks of the schedule.





## 10.2 Implementation Status of Event and Action Plan

Since no exceedance of Action and Limit level of air, noise and marine water monitoring results was recorded for this reporting month, no further action was required.

## 10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

No complaint, notification of summon and successful prosecution was received in this reporting month. A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 10.1 and further details of the complaint could be found in the Complaint Log (Appendix I M).

Table 10.1 Summary of Environmental Complaints and Prosecutions

Complaints logged		Summons served		Successful prosecution received	
November 2013	Cumulative	November 2013	Cumulative	November 2013	Cumulative
0	5	0	0	0	0

## 11.0 CONCLUSIONS AND RECOMMENDATIONS

### Conclusions

Impact monitoring of air quality, noise and water quality were carried out at designated locations in accordance with the EM&A Manual in this reporting month.

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

No complaint, prosecutions and notifications of summons were received in this reporting month.

According to the ET weekly site inspections and IEC site audits carried out in this reporting month, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

### Recommendations

According to the environmental site inspections performed in the reporting month, the following recommendations were provided:

#### **Air Quality**

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowsers;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the site activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.



### **Noise**

- Conduct noisy activities at a farther location from the NSRs.

### **Water Quality**

- Maintain the drainage system, including the trapezoidal channels, permanent desilting chambers, DP3 & DP4 regularly;
- Operate and maintain the silt curtains regularly;
- Operate the cleaning vessel within the TKO Basin regularly;
- Provide proper treatment for the oil discharge from the area near air monitoring station TKO-A1;
- Clean up the fill material on the concrete pavement at BHA frequently; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

### **Chemical and Waste Management**

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain mesh screen on top of the additional drainage to avoid improper dumping of rubbish;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.

### **Landscape and Visual**

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeded slopes in accordance with the Landscape Plan.

## **12.0 FUTURE KEY ISSUES**

### **12.1 Work Programme for the Coming Month**

As informed by the Contractor, the activities to be conducted by them in the next month included:

- *Removal & delivery of public fill stockpiled material to Mainland*
- *Operation of the road water lorries and the road sweeper*
- *Delivery of public fill received at the Chai Wan Public Fill Barging Point to TKO fill bank*
- *Operation and maintenance of the tipping hall (A2 & A3)*
- *Operation of the queuing area for public truck lorries*

### **12.2 Key Issues for the Coming Month**

**Key issues to be considered in the coming month include:**

- *Chemical and waste management;*
- *Treatment of runoff and wastewater prior to discharge;*
- *Dust generated from loading and unloading activities; and*
- *Dust generated from dump trucks traffic.*

**Mitigation measures to be required in the coming month:**

#### Air Quality Impact

- To provide adequate water spraying on haul roads and working platform;
- To operate and maintain automatic wheel washing facilities properly;
- To dampen the fill material prior to unloading or movement;
- To provide road sweeping on haul road near site egress and public roads outside site egress;
- To ensure implementation of the dust mitigation measures for the site activities;
- To maintain proper operation of the mist spraying system;
- To provide proper maintenance for vehicles and machines on site; and
- To investigate any other dust sources around the air sensitive receivers



#### Noise

- To switch off equipment if not in use;
- To operate silent equipment;
- To identify the noise sources inside and outside of the site;
- To follow up any exceedance caused by the Fill Bank operation; and
- To re-schedule the work activities in the event of valid noise exceedance.

#### Water Quality Impact

- To maintain the drainage system in the Fill Bank;
- To ensure the cleanliness of oil interceptor bypass tanks and all the drainage channels;
- To maintain the existing silt trap to ensure good efficiency of wheel wash facilities;
- To repair, inspect and maintain the silt curtains regularly;
- To provide covers for the drip trays to avoid stagnant water pond due to rainfall;
- To provide proper treatment for oily water discharged from the area around air monitoring station TKO-A1;
- To deploy a cleaning vessel to remove floating rubbish in the TKO Basin;
- To clean up the concrete paved area at Portion I every night to avoid fill materials from being washed into the sea; and
- To avoid any stagnant water or provide insecticide to avoid mosquito breeding in the Fill Bank.

#### Chemical and Waste Management

- To remove waste from the site regularly;
- To properly store and handle chemical wastes on site;
- To implement trip ticket system for all the imported public fill and general refuse disposal;
- To provide and manage sufficiently sized drip trays for diesel drums or chemical containers;
- To remove existing unwanted material in the stockpiles and avoid improper disposal at the Fill Bank through inspection of imported truckloads;
- To maintain proper housekeeping at the workshop area;
- To remove the oil stains in the event of leakage and handle all materials using for this cleaning works as chemical waste;
- To maintain mesh screen on top of the additional drainage, DP3 opening to avoid improper dumping of rubbish into this channel; and
- To identify C&D material by packaging, labeling, storage, transportation and disposal in accordance with statutory regulations.

### **12.3 Monitoring Schedule for the Coming Month**

The proposed EM&A program of the coming month is attached in Appendix I L.

- END OF REPORT -

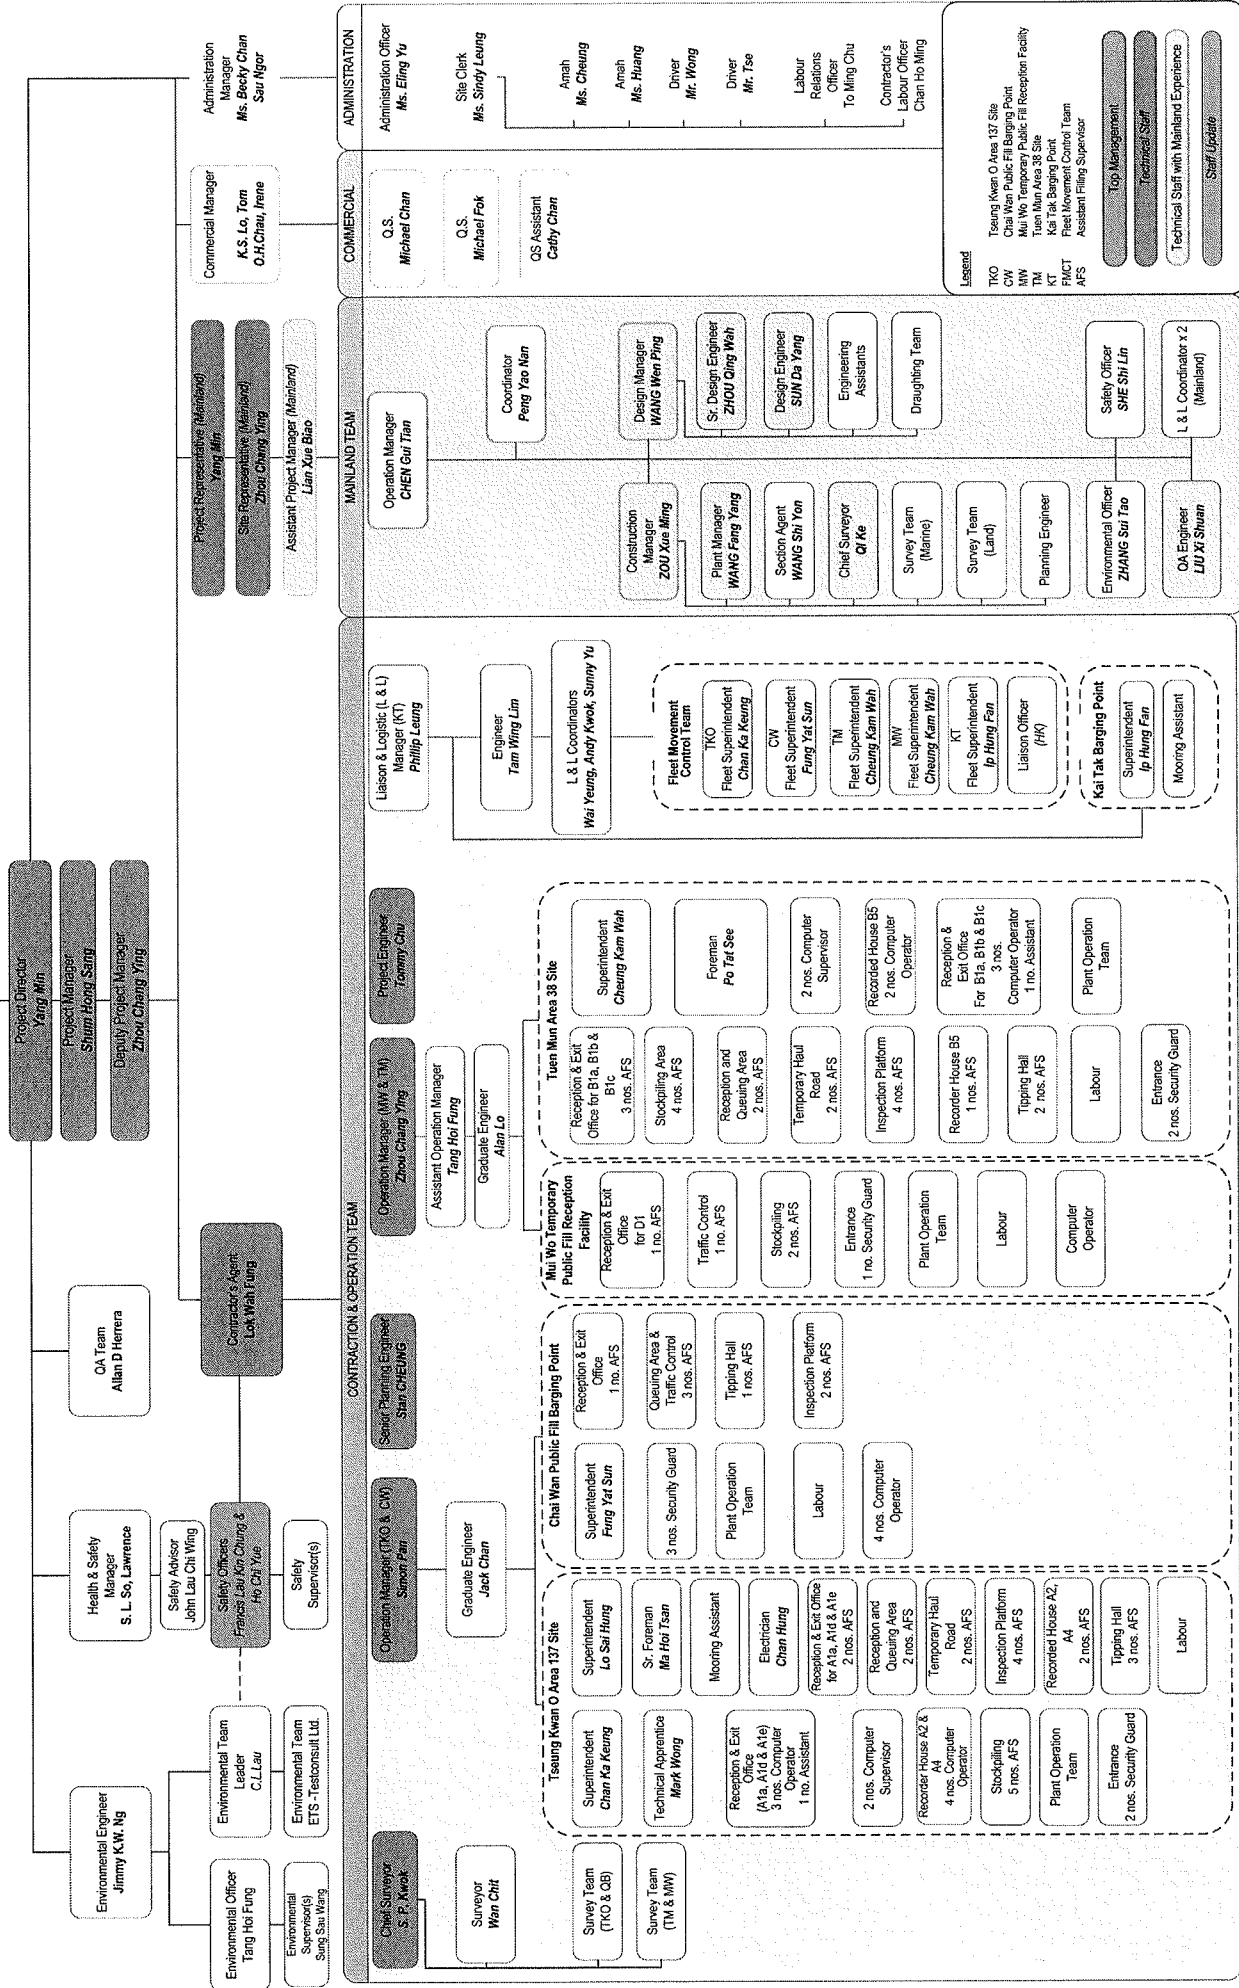


## **Appendix I**

### **A**

## **Organization Chart and Lines of Communication**

**JOINT VENTURE MANAGEMENT BOARD**  
**CHEN Fan Jian, WANG Yan, PAN Shu Jie, George CHAN**



- Legend**
- TKO Teasing Kwan O Area 137 Site
  - CW Mui Wo Temporary Public Fill Reception Facility
  - MW Tuen Mun Area 38 Site
  - TM Chai Wan Temporary Public Fill Reception Facility
  - KT Kai Tak Bargaining Point
  - FMCCT Fleet Movement Control Team
  - AFS Assistant Filing Supervisor
- Top Management
  - Technical Staff
  - Technical Staff with Mainland Experience
  - Staff Update

**Organisation Chart (Rev.9)**  
 Contract No. CV/2009/02  
 Handling of Surplus Public Fill  
 (Revised on 13 August 2012)




**Civil Engineering and Development Department**  
**CIEDD**



China Harbour – China State Joint Venture

# Lines of Communication

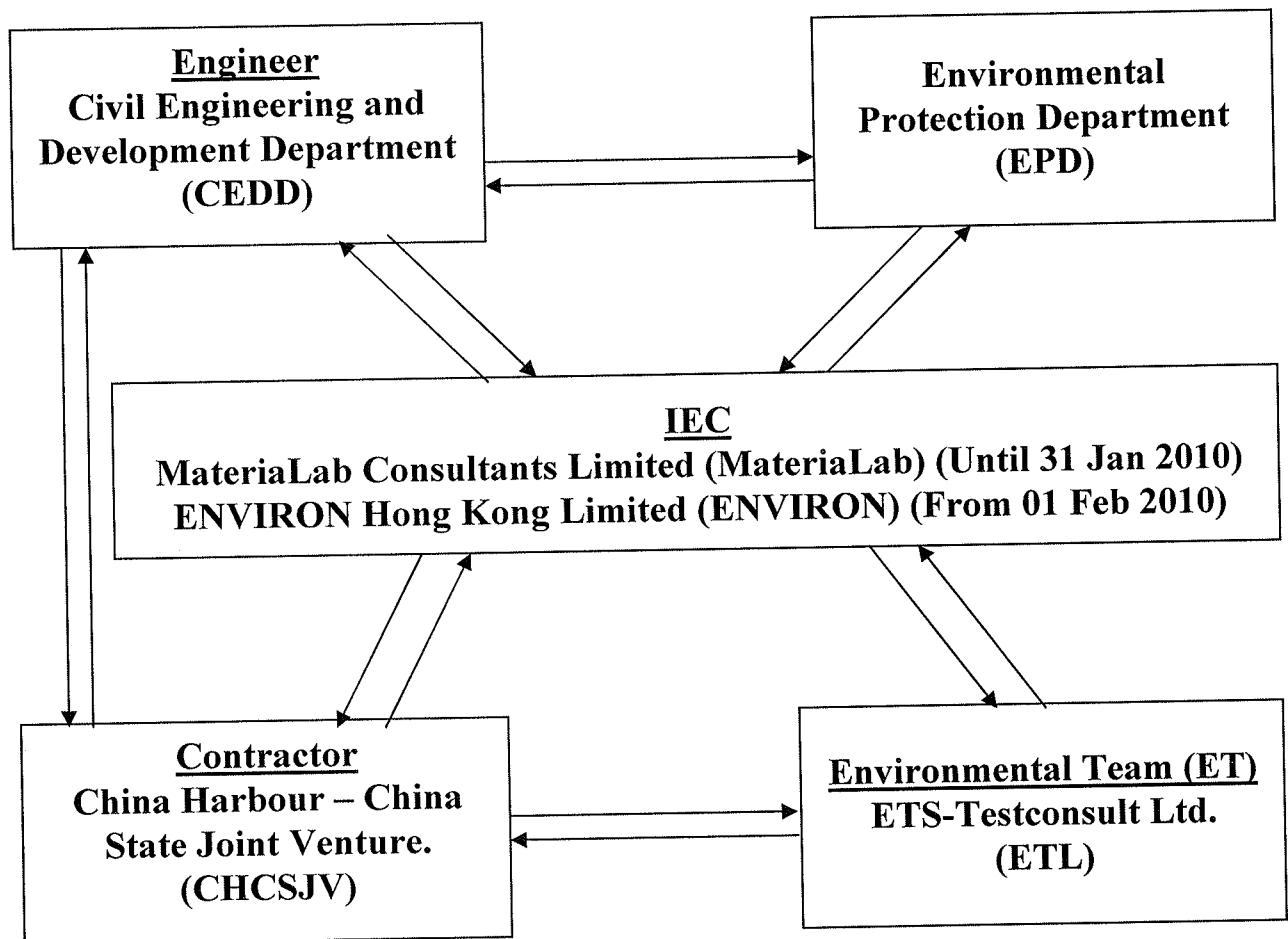



## Appendix I

### B1

# Calibration Certificates for Impact Air Quality Monitoring Equipment



東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong  
Tel : 2695 8318 E-mail : etl@ets-testconsult.com  
Fax : 2695 3944 Web site : www.ets-testconsult.com

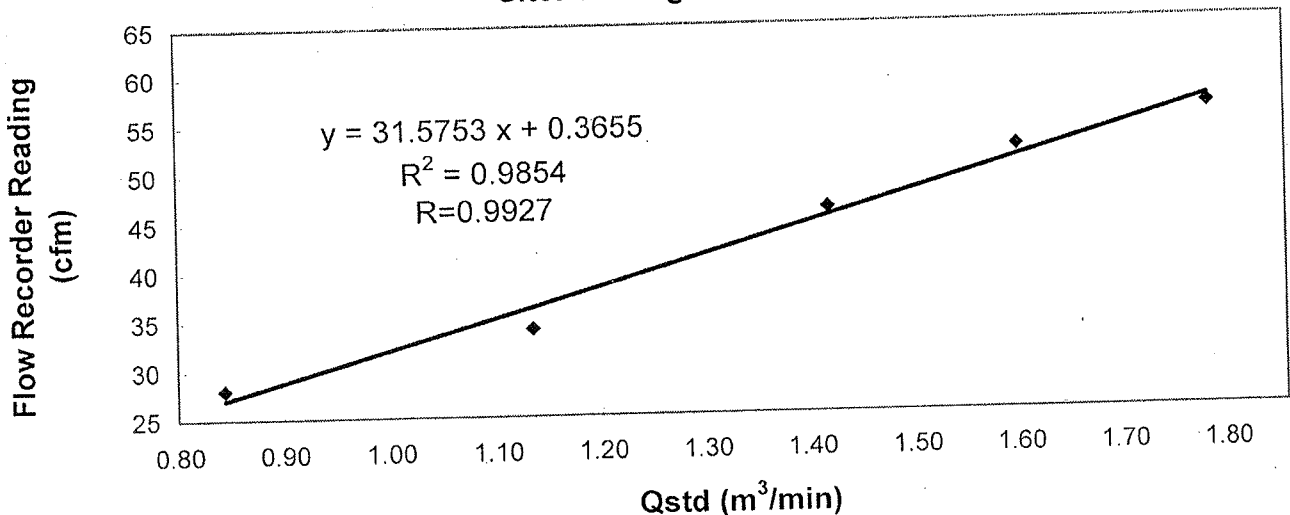
**TEST REPORT**

**Calibration Report**  
of  
**High Volume Air Sampler**

Manufacturer : Graseby GMW Date of Calibration : 06 September 2013  
Serial No. : 10581 ( ET / EA / 003 / 22 ) Calibration Due Date : 05 November 2013  
Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results	Flow recorder reading (cfm)	56	52	46	34	28
	Qstd (Actual flow rate, m <sup>3</sup> /min)	1.78	1.60	1.42	1.14	0.84
	Pressure :	762.06	mm Hg	Temp. :	299	K


**Sampler 10581 Calibration Curve**  
Site: Tseung Kwan O A-1



Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by :   
KWAN, King Ming  
(Senior Site Technician)

Checked by :   
LAW, Sau Yee  
(Senior Environmental Officer)





東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong  
Tel : 2695 8318 E-mail : etl@ets-testconsult.com  
Fax : 2695 3944 Web site : www.ets-testconsult.com


**TEST REPORT**

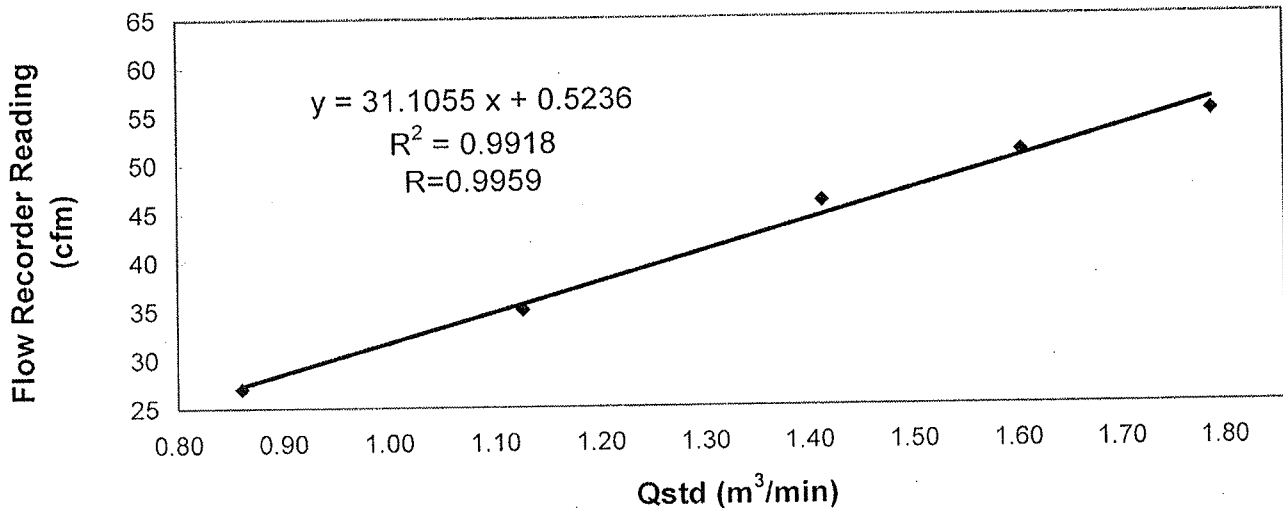**Calibration Report  
of  
High Volume Air Sampler**

Manufacturer : Graseby GMW Date of Calibration : 06 November 2013  
Serial No. : 10581 ( ET / EA / 003 / 22 ) Calibration Due Date : 05 January 2014  
Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results	Flow recorder reading (cfm)	55	51	46	35	27
	Qstd (Actual flow rate, m <sup>3</sup> /min)	1.79	1.60	1.41	1.13	0.86
	Pressure : 763.56 mm Hg	Temp. : 298 K				

**Sampler 10581 Calibration Curve  
Site: Tseung Kwan O A-1**




Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by : MAK, Kei Wai  
MAK, Kei Wai  
(Assistant Supervisor)

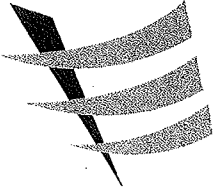Checked by : LAW, Sau Yee  
LAW, Sau Yee  
(Senior Environmental Officer)



東業德勤測試顧問有限公司

ETS-TESTCONSULT LIMITED

8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong

Tel : 2695 8318

E-mail : etl@ets-testconsult.com

Fax : 2695 3944

Web site : www.ets-testconsult.com

**TEST REPORT**

**Calibration Report  
of  
High Volume Air Sampler**

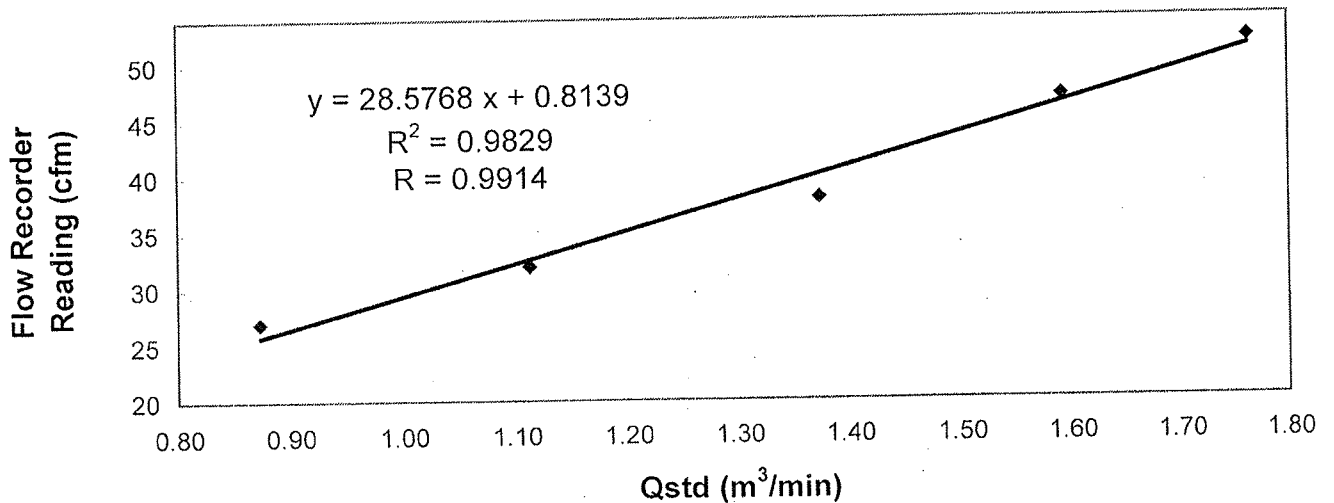
Manufacturer : Graseby GMW Date of Calibration : 06 September 2013

Serial No. : 1172 (ET / EA / 003 / 11) Calibration Due Date : 05 November 2013

Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results	Flow recorder reading (cfm)	52	47	38	32	27
	Qstd (Actual flow rate, m <sup>3</sup> /min)	1.76	1.59	1.37	1.11	0.87
Pressure :		762.06 mm Hg		Temp. :		299 K

**Sampler 1172 Calibration Curve  
Site: Tseung Kwan O A-2**



Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / ~~does not comply\*~~ with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by :   
 KWAN, King Ming  
 (Senior Site Technician)

Checked by :   
 LAW, Sau Yee  
 (Senior Environmental Officer)



東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong  
Tel : 2695 8318 E-mail : etl@ets-testconsult.com  
Fax : 2695 3944 Web site : www.ets-testconsult.com


**TEST REPORT**

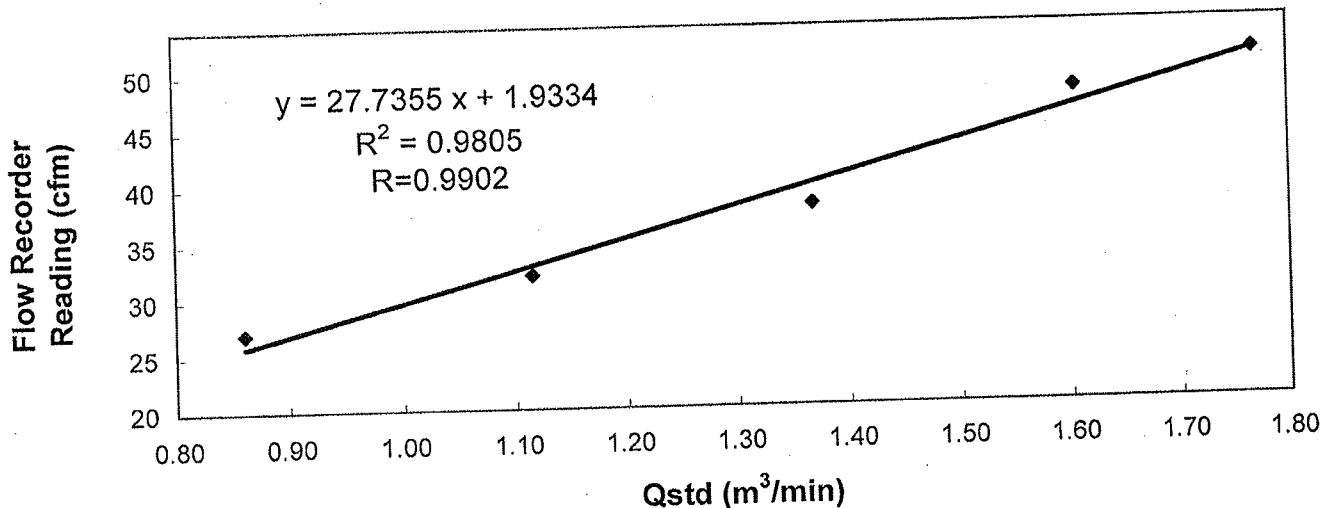**Calibration Report**  
of  
**High Volume Air Sampler**

Manufacturer : Graseby GMW Date of Calibration : 06 November 2013  
Serial No. : 1172 (ET / EA / 003 / 11) Calibration Due Date : 05 January 2014  
Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results	Flow recorder reading (cfm)	51	48	38	32	27
	Qstd (Actual flow rate, m <sup>3</sup> /min)	1.77	1.60	1.37	1.12	0.86
	Pressure :	763.56	mm Hg	Temp. :	298	K

**Sampler 1172 Calibration Curve**  
Site: Tseung Kwan O A-2



Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by : MAK, Kei Wai  
MAK, Kei Wai  
(Assistant Supervisor)

Checked by : LAW, Sau Yee  
LAW, Sau Yee  
(Senior Environmental Officer)



TISCH ENVIRONMENTAL, INC.  
 145 SOUTH MIAMI AVE.  
 VILLAGE OF CLEVELAND, OH 45002  
 513.467.9000  
 877.263.7610 TOLL FREE  
 513.467.9009 FAX  
 WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT  
 ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - May 13, 2013    Roots-meter S/N    0438320    Ta (K) -    296  
 Operator Tisch    Orifice I.D. -    2511    Pa (mm) -    753.11

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER	ORFICE
					DIFF Hg (mm)	DIFF H2O (in.)
1	NA	NA	1.00	1.4400	3.2	2.00
2	NA	NA	1.00	1.0110	6.4	4.00
3	NA	NA	1.00	0.9030	7.9	5.00
4	NA	NA	1.00	0.8630	8.8	5.50
5	NA	NA	1.00	0.7110	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
0.9934	0.6898	1.4125	0.9957	0.6915	0.8866
0.9892	0.9784	1.9976	0.9915	0.9807	1.2539
0.9871	1.0931	2.2334	0.9894	1.0957	1.4019
0.9860	1.1425	2.3424	0.9883	1.1452	1.4703
0.9808	1.3794	2.8251	0.9831	1.3827	1.7732
Qstd slope (m) = 2.05038			Qa slope (m) = 1.28391		
intercept (b) = -0.00442			intercept (b) = -0.00277		
coefficient (r) = 0.99995			coefficient (r) = 0.99995		
y axis = SQRT[H2O(Pa/760)(298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

$$Vstd = \text{Diff. Vol}[(Pa - \text{Diff. Hg})/760](298/Ta)$$

$$Qstd = Vstd/Time$$

$$Va = \text{Diff Vol} [(Pa - \text{Diff Hg})/Pa]$$

$$Qa = Va/Time$$

For subsequent flow rate calculations:

$$Qstd = 1/m\{ [\text{SQRT}(H2O(Pa/760)(298/Ta))] - b\}$$

$$Qa = 1/m\{ [\text{SQRT} H2O(Ta/Pa)] - b\}$$

## **Appendix I**

### **B2**

## **Impact Air Quality Monitoring Results**

## Summary of 24-hr TSP Monitoring Results

Monitoring Station : TKO-A1  
Location : Site Egress

Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
05/11/13	09:00	06/11/13	09:00	20427.33	20451.33	24.00	1.0652	1.0652	1.0652	2.7631	3.0577	192
11/11/13	13:00	12/11/13	13:00	20455.33	20479.33	24.00	1.0441	1.0441	1.0441	2.7516	2.9462	129
17/11/13	09:00	18/11/13	09:00	20481.33	20505.33	24.00	1.0441	1.0441	1.0441	2.7558	2.9562	133
23/11/13	09:00	24/11/13	09:00	20508.33	20532.33	24.00	1.0441	1.0441	1.0441	2.7524	2.9372	123
29/11/13	16:00	30/11/13	16:00	20536.33	20560.33	24.00	1.0762	1.0762	1.0762	2.7594	2.9521	124

Monitoring Station : TKO-A2a  
Location : new CREO

Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
05/11/13	09:00	06/11/13	09:00	19654.44	19678.44	24.00	1.0913	1.0913	1.0913	2.7582	2.9640	131
11/11/13	13:00	12/11/13	13:00	19682.44	19706.44	24.00	1.1562	1.1562	1.1562	2.7493	2.9165	100
17/11/13	09:00	18/11/13	09:00	19708.44	19732.44	24.00	1.1562	1.1562	1.1562	2.7424	2.9306	113
23/11/13	09:00	24/11/13	09:00	19735.44	19759.44	24.00	1.1562	1.1562	1.1562	2.7540	2.9230	102
29/11/13	16:05	30/11/13	16:05	19763.44	19787.44	24.00	1.0840	1.0840	1.0840	2.7338	2.9116	114

## Summary of 1-hr TSP Monitoring Results

Monitoring Station : TKO-A1  
Location : Site Egress

Date	Time		Elapse Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
01/11/13	13:00	14:00	20425.33	20426.33	1.00	1.0652	1.0652	1.0652	2.7402	2.7607	321
04/11/13	11:00	12:00	20426.33	20427.33	1.00	1.0652	1.0652	1.0652	2.7431	2.7614	286
06/11/13	09:35	10:35	20451.33	20752.33	1.00	1.0762	1.0762	1.0762	2.7397	2.7528	203
06/11/13	13:00	14:00	20452.33	20453.33	1.00	1.0762	1.0762	1.0762	2.7227	2.7364	212
08/11/13	09:00	10:00	20453.33	20454.33	1.00	1.0441	1.0441	1.0441	2.7524	2.7666	227
11/11/13	10:45	11:45	20454.33	20455.33	1.00	1.0441	1.0441	1.0441	2.7482	2.7637	247
13/11/13	13:00	14:00	20479.33	20480.33	1.00	1.0441	1.0441	1.0441	2.7482	2.7644	259
15/11/13	10:00	11:00	20480.33	20481.33	1.00	1.0441	1.0441	1.0441	2.7292	2.7432	223
18/11/13	13:52	14:52	20505.33	20506.33	1.00	1.0762	1.0762	1.0762	2.7543	2.7672	200
20/11/13	09:42	10:42	20506.33	20507.33	1.00	1.0762	1.0762	1.0762	2.7495	2.7627	204
22/11/13	13:50	14:50	20507.33	20508.33	1.00	1.0762	1.0762	1.0762	2.7603	2.7743	217
25/11/13	10:10	11:10	20532.33	20533.33	1.00	1.0762	1.0762	1.0762	2.7424	2.7547	190
25/11/13	13:00	14:00	20533.33	20534.33	1.00	1.0762	1.0762	1.0762	2.7410	2.7550	217
27/11/13	10:35	11:35	20534.33	20535.33	1.00	1.0762	1.0762	1.0762	2.7384	2.7536	235
29/11/13	10:45	11:45	20535.33	20536.33	1.00	1.0762	1.0762	1.0762	2.7497	2.7639	220

Monitoring Station : TKO-A2a  
Location : New CREO

Date	Time		Elapse Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
01/11/13	13:05	14:05	19652.44	19653.44	1.00	1.0913	1.0913	1.0913	2.7415	2.7612	301
04/11/13	10:55	11:55	19653.44	19654.44	1.00	1.0913	1.0913	1.0913	2.7502	2.7695	295
06/11/13	09:45	10:45	19678.44	19679.44	1.00	1.0840	1.0840	1.0840	2.7508	2.7618	169
06/11/13	13:00	14:00	19679.44	19680.44	1.00	1.0840	1.0840	1.0840	2.7404	2.7524	185
08/11/13	09:05	10:05	19680.44	19681.44	1.00	1.1562	1.1562	1.1562	2.7510	2.7641	189
11/11/13	10:40	11:40	19681.44	19682.44	1.00	1.1562	1.1562	1.1562	2.7456	2.7599	206
13/11/13	13:05	14:05	19706.44	19707.44	1.00	1.1562	1.1562	1.1562	2.7465	2.7612	212
15/11/13	10:05	11:05	19707.44	19708.44	1.00	1.1562	1.1562	1.1562	2.7360	2.7491	189
18/11/13	14:05	15:05	19732.44	19733.44	1.00	1.0840	1.0840	1.0840	2.7485	2.7602	180
20/11/13	09:55	10:55	19733.44	19734.44	1.00	1.0840	1.0840	1.0840	2.7473	2.7597	191
22/11/13	13:55	14:55	19734.44	19735.44	1.00	1.0840	1.0840	1.0840	2.7588	2.7717	198
25/11/13	10:15	11:15	19759.44	19760.44	1.00	1.0840	1.0840	1.0840	2.7389	2.7504	177
25/11/13	13:00	14:00	19760.44	19761.44	1.00	1.0840	1.0840	1.0840	2.7432	2.7555	189
27/11/13	10:30	11:30	19761.44	19762.44	1.00	1.0840	1.0840	1.0840	2.7404	2.7543	214
29/11/13	10:50	11:50	19762.44	19763.44	1.00	1.0840	1.0840	1.0840	2.7606	2.7727	186



## **Appendix I**

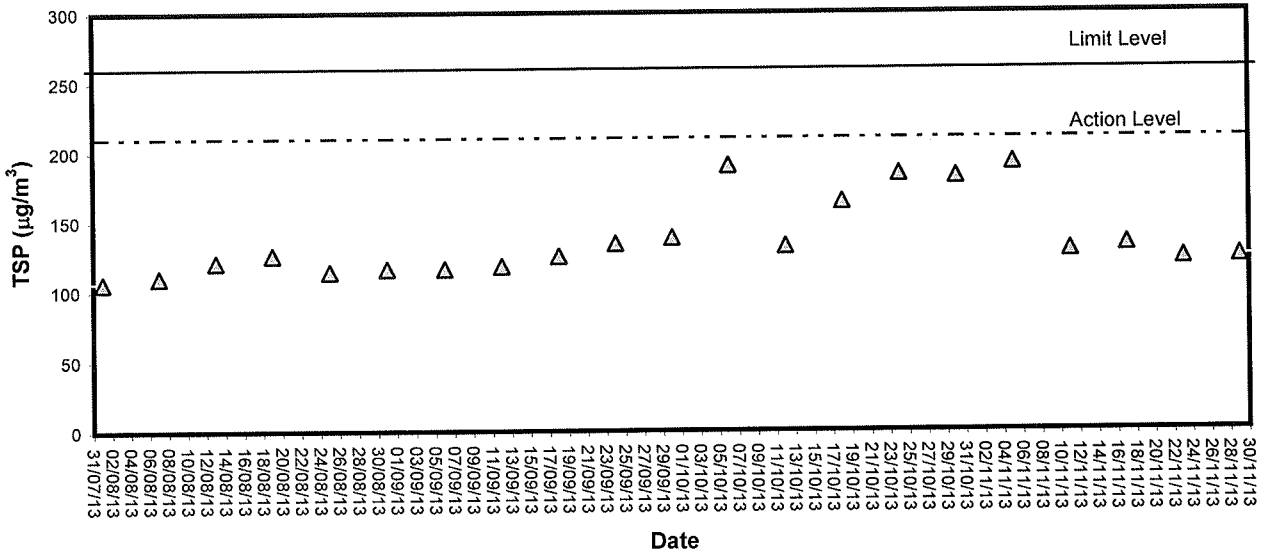
### **B3**

## **Graphical Plots of Impact Air Quality Monitoring Data**






### 24-hour TSP level at TKO-A1




### 24-hour TSP level at TKO-A2a

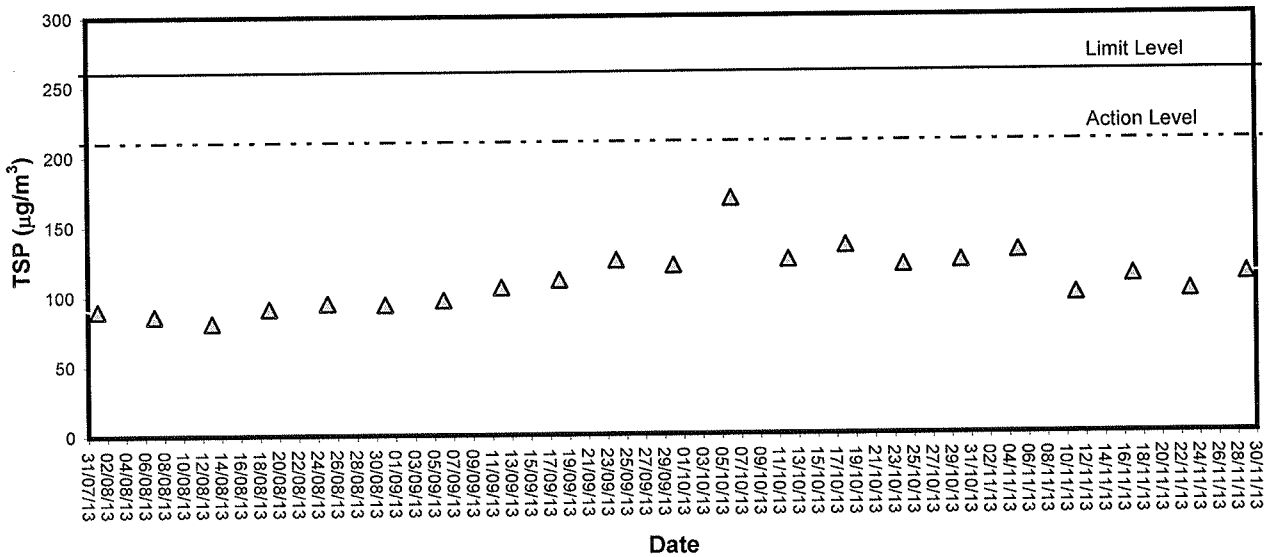




1-hour TSP level at TKO-A1

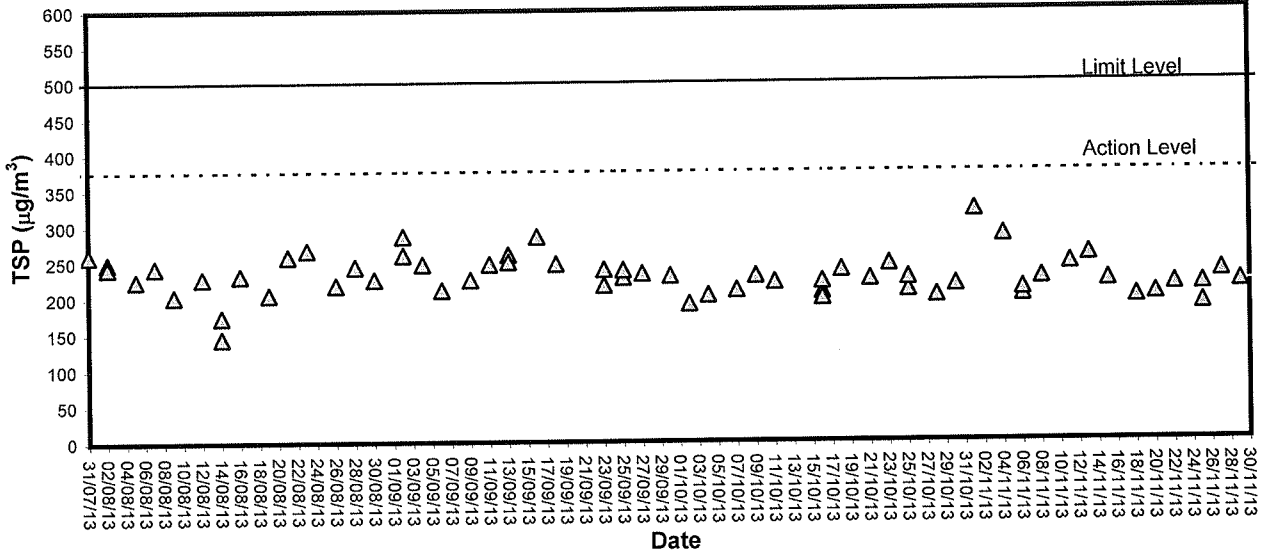

1-hour TSP level at TKO-A2a

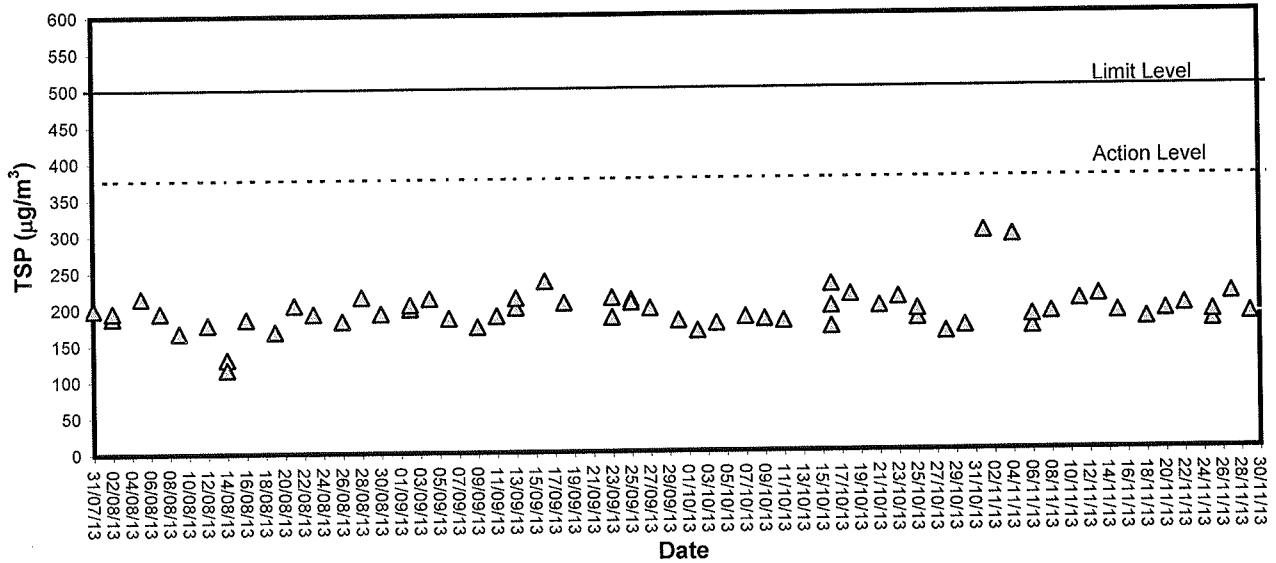



## **Appendix I**

### **C1**

## **Calibration Certificates for Impact Noise Monitoring Equipment**



# Calibration Certificate

Certificate No. **28322**

Page 1 of 3 Pages

**Customer :** ETS-Testconsult Limited

**Address :** 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

**Order No. :** Q23231

**Date of receipt :** 4-Dec-12

## Item Tested

**Description :** Precision Integrating Sound Level Meter (ET/EN/003/12)

**Manufacturer :** Rion

**Model :** NL-31

**Serial No. :** 00773032

## Test Conditions

**Date of Test :** 12-Dec-12

**Supply Voltage :** --

**Ambient Temperature :** (23 ± 3)°C

**Relative Humidity :** (50 ± 25) %

## Test Specifications

Calibration check.

Ref. Document/Procedure : Z01.

## Test Results


All results were within the IEC 651 Type1 and IEC 804 Type1 specifications after adjustment.  
The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S017	Multi-Function Generator	C101623	SCL-HKSAR
S024	Sound Level Calibrator	15136	NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).  
The test results apply to the above Unit-Under-Test only


Calibrated by :   
Stephen Chu

Approved by :   
Dorothy Cheuk

Date: 12-Dec-12

This Certificate is issued by:  
Hong Kong Calibration Ltd.  
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.  
Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



# Calibration Certificate

Certificate No. 28322

Results :

## 1. SPL Accuracy

UUT Setting			Applied Value (dB)	UUT Reading (dB)
Level Range (dB)	Weight	Response		
20 - 100	L <sub>A</sub>	Fast	94.0	94.3
		Slow		94.3
	L <sub>C</sub>	Fast		94.3
	L <sub>p</sub>	Fast		94.3
30 - 120	L <sub>A</sub>	Fast	94.0	94.2
		Slow		94.2
	L <sub>C</sub>	Fast		94.2
	L <sub>p</sub>	Fast		94.3
30 - 120	L <sub>A</sub>	Fast	114.0	114.2
		Slow		114.2
	L <sub>C</sub>	Fast		114.2
	L <sub>p</sub>	Fast		114.2

IEC 651 Type 1 Spec. :  $\pm 0.7$  dB  
Uncertainty :  $\pm 0.1$  dB

2. **Level Stability** : 0.0 dB  
IEC 651 Type 1 Spec. :  $\pm 0.3$  dB  
Uncertainty :  $\pm 0.01$  dB

## 3. Linearity

### 3.1 Level Linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec. (Primary Indicator Range)
130	114.0	114.2	0.0	$\pm 0.7$ dB
130	104.0	104.2	0.0	
120	94.0	94.2 (Ref.)	--	
110	84.0	84.3	+ 0.1	
100	74.0	74.3	+ 0.1	
90	64.0	64.3	+ 0.1	
80	54.0	54.3	+ 0.1	

Uncertainty :  $\pm 0.1$  dB



# Calibration Certificate

Certificate No. 28322

Page 3 of 3 Pages

## 3.2 Differential level linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec.
120	84.0	84.3	+ 0.1	± 0.4 dB
	94.0	94.2 (Ref.)	--	
	95.0	95.2	0.0	± 0.2 dB

Uncertainty : ± 0.1 dB

## 4. Frequency Weighting - A weighting

Frequency	Attenuation (dB)	IEC 651 Type 1 Spec.
31.5 Hz	- 39.7	- 39.4 dB, ± 1.5 dB
63 Hz	- 26.3	- 26.2 dB, ± 1.5 dB
125 Hz	- 16.3	- 16.1 dB, ± 1 dB
250 Hz	- 8.8	- 8.6 dB, ± 1 dB
500 Hz	- 3.3	- 3.2 dB, ± 1 dB
1 kHz	0.0 (Ref.)	0 dB, ± 1 dB
2 kHz	+ 1.2	+ 1.2 dB, ± 1 dB
4 kHz	+ 1.0	+ 1.0 dB, ± 1 dB
8 kHz	- 1.2	- 1.1 dB, + 1.5 dB ~ - 3 dB
16 kHz	- 6.6	- 6.6 dB, + 3 dB ~ ∞

Uncertainty : ± 0.1 dB

## 5. Time Averaging

Applied Burst duty Factor	Applied Leq Value (dB)	UUT Reading (dB)	IEC 804 Type 1 Spec.
continuous	40.0	--	--
1/10	40.0	40.1	± 0.5 dB
1/10 <sup>2</sup>	40.0	39.8	
1/10 <sup>3</sup>	40.0	40.3	± 1.0 dB
1/10 <sup>4</sup>	40.0	39.8	

Uncertainty : ± 0.1 dB

- Remarks:
1. UUT : Unit-Under-Test
  2. The uncertainty claimed is for a confidence probability of not less than 95%.
  3. Atmospheric Pressure : 1010 hPa
  4. The UUT's internal calibration was performed before the calibration.

----- END -----



# Calibration Certificate

Certificate No. **31716**

Page 1 of 2 Pages

**Customer :** ETS-Testconsult Limited

**Address :** 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

**Order No. :** Q30704

**Date of receipt :** 13-Mar-13

## Item Tested

**Description :** Acoustic Calibrator

**Manufacturer :** Castle

**Model :** GA607

**Serial No. :** 038641

## Test Conditions

**Date of Test :** 20-Mar-13

**Supply Voltage :** --

**Ambient Temperature :** (23 ± 3)°C

**Relative Humidity :** (50 ± 25) %

## Test Specifications

Calibration check.

Ref. Document/Procedure : F06, F20, Z02.

## Test Results

All results were within the IEC 942 Class 1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S014	Spectrum Analyzer	30259	NIM-PRC & SCL-HKSAR
S024	Sound Level Calibrator	30620	NIM-PRC & SCL-HKSAR
S041	Universal Counter	28347	SCL-HKSAR
S206	Sound Level Meter	30655	SCL-HKSAR


The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).  
The test results apply to the above Unit-Under-Test only

**Calibrated by :**

  
Liam Wong

**Approved by :**

  
Dorothy Cheuk

**Date:** 20-Mar-13

This Certificate is issued by:  
Hong Kong Calibration Ltd.  
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.  
Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



# Calibration Certificate

Certificate No. 31716

Page 2 of 2 Pages

Results :

## 1. Level Accuracy

UUT Setting (dB)	Measured Value (dB)		IEC 942 Class 1 Spec.
	Before adjust	After adjust	
94.0	93.72	94.11	± 0.3 dB

Uncertainty : ± 0.1 dB

## 2. Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	IEC 942 Class 1 Spec.
1.000	1.000	± 2 %

Uncertainty : ± 3.6 x 10<sup>-6</sup>

- 3. Level Stability : 0.0 dB**  
IEC 942 Class 1 Spec.: ± 0.1 dB  
Uncertainty : ± 0.01 dB

- 4. Total Harmonic Distortion : < 2.8 %**  
IEC 942 Class 1 Spec. : < 3 %  
Uncertainty : ± 2.3 % of rdg.

- Remark : 1. UUT : Unit-Under-Test  
2. The above measured values were the mean of 3 measurements.  
3. The uncertainty claimed is for a confidence probability of not less than 95%.  
4. Atmospheric Pressure : 1003 hPa.

----- END -----





## Appendix I

### C2

## Impact Noise Monitoring Results



## Day-time Noise Monitoring

Monitoring Location: TKO-N1 (Site Egress)

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L <sub>eq(30min)</sub>	L <sub>10</sub>	L <sub>90</sub>		
06/11/13	13:00	66.7	68.5	63.1	0.4	Cloudy



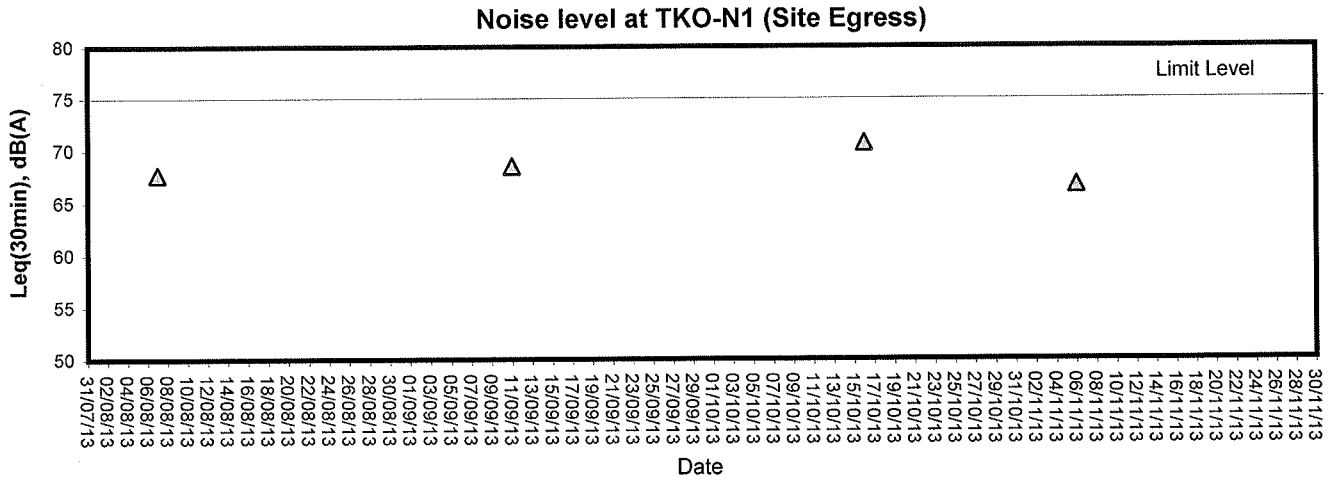
## Appendix I

### C3

## Graphical Plots of Impact Noise Monitoring Data



## Noise Monitoring (Day-time)





## **Appendix I**

### **D1**

# **Calibration Certificates for Impact Marine Water Quality Monitoring Equipments**



### Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/004</u>	Manufacturer : <u>YSI</u>
Model No. : <u>Pro 2030</u>	Serial No. : <u>10F 101978</u>
Date of Calibration : <u>29/10/2013</u>	Calibration Due Date : <u>28/01/2014</u>

**Temperature Verification**

Ref. No. of Reference Thermometer : ET/0521/008  
 Ref. No. of Water Bath : ---

		Temperature (°C)		
Reference Thermometer reading	Measured	20.3	Corrected	19.9
DO Meter reading	Measured	19.8	Difference	0.1

**Standardization of sodium thiosulphate (Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>) solution**

Reagent No. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> titrant	CPE/012/4.5/001/7	Reagent No. of 0.025N K <sub>2</sub> Cr <sub>2</sub> O <sub>7</sub>	CPE/012/4.4/001/22
		Trial 1	Trial 2
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		1.00	12.00
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		11.55	22.50
Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)		10.55	10.50
Normality of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02370	0.02381
Average Normality (N) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02376	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>, N = 0.25 / ml Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub> used

**Linearity Checking**

**Determination of dissolved oxygen content by Winkler Titration \***

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	11.40	22.60	0.00	8.20	13.30
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	11.40	22.60	31.00	8.20	13.30	18.30
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	11.40	11.20	8.40	8.20	5.10	5.00
Dissolved Oxygen (DO), mg/L	7.27	7.14	5.36	5.23	3.25	3.19
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.22	7.10	7.16	7.27	7.14	7.21	0.70
5	5.34	5.16	5.25	5.36	5.23	5.30	0.95
10	3.32	3.11	3.22	3.25	3.19	3.22	0.00
Linear regression coefficient				0.9981			



## Internal Calibration Report of Dissolved Oxygen Meter

### Zero Point Checking

DO meter reading, mg/L	0.00
------------------------	------

### Salinity Checking

Reagent No. of NaCl (10ppt)	CPE/012/4.7/002/11	Reagent No. of NaCl (30ppt)	CPE/012/4.8/002/11
-----------------------------	--------------------	-----------------------------	--------------------

### Determination of dissolved oxygen content by Winkler Titration \*\*

Salinity (ppt)	10		30	
	1	2	1	2
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	12.30	24.50	35.80
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	12.30	24.50	35.80	46.90
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	12.30	12.20	11.30	11.10
Dissolved Oxygen (DO), mg/L	7.85	7.78	7.21	7.08
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation:  $DO (mg/L) = V \times N \times 8000/298$

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.86	7.91	7.89	7.85	7.78	7.82	0.89
30	7.29	7.24	7.27	7.21	7.08	7.15	1.66

### Acceptance Criteria

- (1) Difference between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / does not comply # with the specified requirements and is deemed acceptable # / unacceptable # for use.

# Delete as appropriate

Calibrated by :

Approved by :



## Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/004      Manufacturer : YSI  
Model No. : Pro 2030      Serial No. : 10F 101978  
Date of Calibration : 29/10/2013      Due Date : 28/01/2014

Ref. No. of Salinity Standard used (30ppt)

S/001/5


Salinity Standard (ppt)	Measured Salinity (ppt)	Difference %
30.0	32.1	6.76

Acceptance Criteria

Difference : <10 %

The salinity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 





## Performance Check of Turbidity Meter


Equipment Ref. No. : ET/0505/009                      Manufacturer : HACH  
Model No. : 2100Q                                      Serial No. : 11060 C 010010  
Date of Calibration : 08/10/2013                      Due Date : 07/01/2014


Gelex Vial Std	Theoretical Value (NTU)	Measured Value (NTU)	Difference %
0-10 NTU	5	5.2	3.92
10-100 NTU	50	5.19	3.73
100-1000 NTU	550	561	1.98

Acceptance Criteria

Difference : -5 % to 5%

The turbidity meter complies \* / ~~does not comply~~\* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~\* for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 



## **Appendix I**

### **D2**

## **Impact Marine Water Quality Monitoring Results**

**Mid-Flood Tide**

**Monitoring Station : TKO-C1**



專業檢測顧問有限公司  
ETS-TESTCONSULT LIMITED

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	
01/11/13	1530-1548	26/Fine	Surface	25.6	26.6	5.90	5.91	82.6	82.7	2.83	2.84	4.0	4.0	3.9				
			Middle	25.4	26.5	5.92	5.78	82.8	81.0	2.85	2.77	4.0	3.7					
			Bottom	25.3	26.7	5.77	5.66	80.8	79.2	2.76	3.04	3.8	3.9					
04/11/13	1700-1715	23/Cloudy	Surface	25.9	24.7	5.67	5.85	79.3	83.0	3.03	4.05	5.2	5.0	4.5				
			Middle	25.8	24.8	5.82	5.92	82.6	84.0	4.02	3.25	4.8	4.1					
			Bottom	25.7	24.7	5.88	5.75	83.4	81.6	4.08	3.45	4.2	4.5					
06/11/13	0800-0820	27/Cloudy	Surface	25.8	24.7	5.91	5.95	81.1	84.4	3.42	3.92	4.6	4.7	4.4				
			Middle	25.7	24.8	5.78	6.06	82.0	85.9	3.48	3.16	4.8	4.1					
			Bottom	25.7	24.9	5.94	5.85	84.2	82.9	3.93	3.38	4.6	4.5					
08/11/13	0930-0950	26/Cloudy	Surface	25.6	24.6	5.96	6.00	84.5	85.1	3.17	3.83	5.2	5.0	4.4				
			Middle	25.6	24.5	6.04	6.11	85.6	86.5	3.15	3.07	4.2	3.9					
			Bottom	25.5	24.7	6.07	5.90	86.1	83.6	3.37	3.29	4.4	4.3					
11/11/13	1230-1245	25/Cloudy	Surface	25.6	25.2	5.89	6.09	83.4	84.9	3.28	3.05	4.4	4.1	4.2				
			Middle	25.5	25.2	5.91	5.85	83.7	81.6	3.02	3.16	4.0	4.3					
			Bottom	25.4	25.3	6.12	5.93	84.7	82.8	3.08	3.25	4.2	4.3					
13/11/13	1430-1445	25/Cloudy	Surface	25.4	25.3	5.94	6.05	82.9	84.4	3.22	2.87	3.6	3.7	3.9				
			Middle	25.3	25.4	6.03	5.81	84.2	81.1	2.84	2.98	3.8	3.9					
			Bottom	25.2	25.4	6.06	5.89	80.6	82.2	2.96	3.07	4.0	4.1					
15/11/13	1530-1549	25/Fine	Surface	25.6	25.2	5.88	6.13	82.4	85.6	3.10	2.86	3.6	3.7	4.0				
			Middle	25.5	25.4	6.14	5.85	85.4	81.9	2.86	2.92	3.8	4.1					
			Bottom	25.5	25.3	5.86	5.93	82.0	83.2	2.91	3.09	4.0	4.1					
18/11/13	1700-1719	25/Fine	Surface	25.6	25.2	5.92	6.12	83.3	85.7	3.07	2.87	3.6	3.7	3.8				
			Middle	25.5	25.3	5.94	5.83	85.5	81.7	2.86	2.74	3.8	3.7					
			Bottom	25.3	25.5	5.92	5.91	81.8	83.1	2.73	2.92	3.6	4.1					

**Mid-Flood Tide**



東業德動測試顧問有限公司  
ETS-TESTCONSULT LIMITED

**Monitoring Station : TKO-C1**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)				
			Surface	Middle		Bottom	Value	Average	Depth-average	Value	Average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	
20/11/13	0800-0814	22/Cloudy	Surface	1.0	23.4	25.2	25.2	6.13	6.12	6.01	81.6	81.5	2.84	2.85	4.0	3.8				
			Middle	9.9	23.5	25.3	5.89	5.90	6.01	81.3	78.6	2.86	2.73	3.6	3.7	3.9				
			Bottom	18.8	23.6	25.3	5.91	6.00	6.00	78.7	79.9	2.72	2.91	3.6	4.1	4.0	4.1			
22/11/13	0830-0850	20/Cloudy	Surface	1.0	23.0	28.1	28.1	6.01	6.51	6.41	91.1	91.0	2.94	2.95	4.0	4.0				
			Middle	9.9	22.9	28.3	6.32	6.31	6.41	90.9	84.3	2.96	3.26	4.2	4.3	4.4				
			Bottom	18.8	22.9	28.2	6.30	6.53	6.53	88.2	91.4	3.28	4.04	4.4	4.9	5.0	4.9			
25/11/13	1130-1145	20/Fine	Surface	1.0	23.2	25.3	25.4	6.20	6.17	6.21	82.4	82.0	3.81	3.85	4.8	4.9				
			Middle	9.8	23.1	25.5	6.23	6.25	6.21	81.5	83.1	3.89	3.55	5.0	4.5	4.6	4.8			
			Bottom	18.6	23.1	25.6	6.27	5.99	5.99	83.4	79.7	3.56	3.92	4.4	5.1	5.0	5.1			
27/11/13	1300-1315	21/Cloudy	Surface	1.0	23.2	25.2	25.3	5.98	6.14	6.19	79.8	81.6	3.92	3.13	4.4	4.2				
			Middle	9.7	23.1	25.4	6.27	6.24	6.19	81.8	82.9	3.11	3.47	4.0	4.7	4.6	4.4			
			Bottom	18.4	23.0	25.5	6.21	6.11	6.11	82.5	81.2	3.49	3.36	4.4	4.3	4.4	4.3			
29/11/13	1400-1415	20/Cloudy	Surface	1.0	21.5	25.0	25.0	6.30	6.32	6.21	81.1	82.7	3.34	3.24	4.4	4.2				
			Middle	9.9	21.6	24.9	6.10	6.09	6.21	82.4	79.7	3.22	3.52	4.0	4.7	4.6	4.7	4.6		
			Bottom	18.5	21.7	25.1	5.94	5.96	5.96	77.7	78.0	3.82	3.82	5.0	4.9	4.8	4.8			

# Mid-Flood Tide

Monitoring Station : TKO-M4



專業檢測顧問有限公司  
ETS-TESTCONSULT LIMITED

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	
01/11/13	1718-1730	26/Fine	Surface	1.0	25.5	26.7	26.7	5.87	5.86	82.2	82.1	2.77	2.76	3.6	3.7	4.0		
			Middle	4.8	25.4	26.8	26.8	5.85	5.68	82.0	79.5	2.75	2.92	3.8	4.1			
			Bottom	8.6	25.2	26.7	26.7	5.69	5.71	79.6	79.8	2.91	3.09	4.0	4.1			
04/11/13	1845-1900	23/Cloudy	Surface	1.0	25.8	24.6	24.6	5.96	5.93	84.5	84.1	3.12	3.15	4.0	4.1	4.4		
			Middle	4.1	25.8	24.7	24.7	5.90	5.53	83.7	78.5	3.18	3.45	4.2	4.5			
			Bottom	7.2	25.7	24.6	24.6	5.52	5.93	78.6	84.1	3.42	3.45	4.4	4.5			
06/11/13	0940-1000	27/Cloudy	Surface	1.0	25.9	24.7	24.7	6.00	6.01	84.3	85.3	3.49	3.05	4.0	4.1	4.4		
			Middle	4.3	25.8	24.7	24.8	5.62	5.64	83.8	79.9	3.04	3.34	4.2	4.3			
			Bottom	7.6	25.7	24.8	24.8	5.65	5.73	79.6	81.3	3.32	3.44	4.4	4.7			
08/11/13	1110-1130	26/Cloudy	Surface	1.0	25.8	24.7	24.7	6.05	6.06	81.1	85.9	3.46	2.96	4.0	3.9	4.2		
			Middle	4.4	25.6	24.8	24.8	5.67	5.69	81.4	80.6	2.95	3.25	4.2	4.3			
			Bottom	7.8	25.6	24.8	24.9	5.70	5.78	80.8	81.9	3.26	3.35	4.4	4.3			
11/11/13	1415-1430	25/Cloudy	Surface	1.0	25.6	25.1	25.2	5.92	5.94	81.8	82.9	3.37	3.25	4.0	4.3	4.5		
			Middle	4.4	25.5	25.3	25.4	5.74	5.72	82.0	79.8	3.24	3.46	4.4	4.5			
			Bottom	7.8	25.5	25.4	25.5	5.85	5.86	79.5	81.8	3.48	3.64	4.4	4.7			
13/11/13	1615-1630	25/Cloudy	Surface	1.0	25.3	25.4	25.4	5.88	5.90	81.9	82.3	3.66	3.07	4.0	4.1	4.3		
			Middle	4.4	25.3	25.5	25.5	5.92	5.68	82.0	79.3	3.06	3.28	4.2	4.3			
			Bottom	7.8	25.2	25.5	25.6	5.66	5.83	79.6	81.3	3.26	3.46	4.4	4.5			
15/11/13	1710-1730	25/Fine	Surface	1.0	25.6	25.3	25.4	5.82	5.82	81.4	83.2	3.44	3.06	4.0	4.2	4.5		
			Middle	4.3	25.5	25.4	25.4	5.94	5.70	83.0	79.8	3.48	3.26	4.2	4.5			
			Bottom	7.6	25.4	25.5	25.5	5.69	5.82	79.9	81.6	3.07	3.43	4.4	4.7			
18/11/13	1840-1900	25/Fine	Surface	1.0	25.5	25.2	25.2	5.87	5.88	81.7	82.3	3.42	3.04	4.0	4.1	4.2		
			Middle	4.4	25.4	25.3	25.4	5.89	5.73	82.1	80.3	3.02	3.21	4.2	4.1			
			Bottom	7.8	25.3	25.5	25.5	5.72	5.83	80.4	82.0	3.22	3.45	4.0	4.5			

# Mid-Flood Tide



東業德勳測試顧問有限公司  
ETS-TESTCONSULT LIMITED

## Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	0940-1000	22/Cloudy	Surface	23.3	25.3	5.92	5.93	78.8	79.0	3.04	3.05	4.0	4.1	4.3			
				23.4	25.3	5.73	5.74	79.1	76.3	3.06	3.21	4.2	4.3				
				23.5	25.4	5.74	5.82	76.5	77.7	3.19	3.48	4.4	4.5				
			Middle	23.3	25.3	5.94	5.93	79.1	76.3	3.06	3.21	4.2	4.3				
				23.4	25.3	5.73	5.74	76.5	77.7	3.19	3.48	4.4	4.5				
				23.5	25.4	5.74	5.82	76.5	77.7	3.21	3.47	4.4	4.5				
22/11/13	1006-1030	20/Cloudy	Surface	22.9	28.4	6.34	6.32	88.7	88.5	3.16	3.18	4.0	4.1	4.5			
				22.9	28.4	6.30	6.53	88.2	91.8	3.20	3.37	4.2	4.5				
				22.8	28.5	6.50	6.29	90.9	88.0	3.39	4.12	4.6	4.9				
			Middle	22.9	28.4	6.56	6.53	91.8	91.4	3.37	3.38	4.4	4.5				
				23.2	28.5	6.11	6.11	81.2	81.2	3.29	3.30	4.0	4.2				
				23.1	25.4	6.10	6.25	83.2	83.1	3.58	3.59	4.6	4.7				
25/11/13	1315-1330	20/Fine	Surface	23.3	25.3	6.31	6.31	88.2	83.9	3.69	3.71	4.6	4.7	4.5			
				23.2	25.3	6.30	6.31	83.8	83.9	3.72	3.71	4.8	4.7				
				23.1	25.7	6.24	6.25	82.9	83.1	3.80	3.59	4.8	4.7				
			Middle	23.2	25.4	6.11	6.11	81.2	81.2	3.29	3.30	4.0	4.2				
				23.2	25.4	6.10	6.25	83.2	83.1	3.58	3.59	4.6	4.7				
				23.1	25.7	6.24	6.25	82.9	83.1	3.80	3.59	4.8	4.7				
27/11/13	1440-1500	21/Cloudy	Surface	23.3	25.3	6.25	6.24	83.1	83.0	3.02	3.03	4.0	4.0	4.5			
				23.2	25.3	6.23	6.37	82.8	84.6	3.04	3.54	4.0	4.7				
				23.1	25.7	6.13	6.16	81.4	81.9	3.73	3.76	4.6	4.7				
			Middle	23.2	25.4	6.36	6.37	84.5	84.6	3.51	3.54	4.6	4.7				
				23.2	25.4	6.38	6.37	84.7	84.6	3.57	3.54	4.8	4.7				
				23.1	25.6	6.13	6.16	81.4	81.9	3.73	3.76	4.6	4.7				
29/11/13	1545-1600	20/Cloudy	Surface	21.6	25.1	6.18	6.19	80.8	81.0	3.07	3.08	4.0	4.1	4.3			
				21.7	25.0	6.20	6.05	81.1	79.2	3.09	3.25	4.2	4.3				
				21.8	25.2	6.07	5.95	79.4	77.8	3.21	3.41	4.4	4.5				
			Middle	21.6	25.0	6.03	6.05	78.9	79.2	3.29	3.25	4.2	4.3				
				21.7	24.9	6.07	5.95	79.4	77.8	3.21	3.25	4.4	4.3				
				21.8	25.2	5.99	5.95	78.3	77.8	3.42	3.41	4.6	4.5				
Bottom	21.6	25.0	6.20	6.19	81.1	81.0	3.07	3.08	4.0	4.1							
	21.7	24.9	6.07	5.95	79.4	77.8	3.21	3.25	4.4	4.3							
Bottom	21.8	25.2	5.99	5.95	78.3	77.8	3.42	3.41	4.6	4.5							



Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Value	Average
01/11/13	0930-0948	26/Fine	Surface	25.5	26.5	26.5	5.85	5.86	5.79	81.9	82.0	2.92	2.93	4.0	4.1	4.0		
					26.4		82.0			2.94		4.2						
					26.5		80.0			2.85		3.8						
04/11/13	1130-1145	22/Cloudy	Middle	25.3	26.6	26.6	5.71	5.72	5.60	80.2	80.1	2.87	2.86	3.6	3.7	4.0		
					26.7		80.2			2.87		3.6						
					26.6		80.2			2.87		3.6						
06/11/13	1300-1320	26/Cloudy	Bottom	25.2	26.7	26.7	5.61	5.60	5.60	78.4	78.3	3.14	3.13	4.2	4.3	4.3		
					26.7		78.1			3.12		4.4						
					26.6		78.1			3.12		4.4						
08/11/13	1500-1520	26/Cloudy	Surface	25.9	24.5	24.6	6.09	6.10	5.92	86.4	86.5	3.10	3.11	4.0	4.1	4.3		
					24.6		86.5			3.12		4.0						
					24.7		86.5			3.12		4.0						
11/11/13	1800-1818	25/Cloudy	Middle	25.8	24.7	24.7	5.77	5.75	5.84	81.8	81.6	3.42	3.45	4.6	4.5	4.6		
					24.6		81.3			3.48		4.4						
					24.8		81.3			3.48		4.4						
13/11/13	0800-0815	25/Cloudy	Bottom	25.7	24.8	24.8	5.49	5.50	5.85	77.9	78.1	3.36	3.38	4.2	4.3	4.3		
					24.8		78.2			3.40		4.4						
					24.7		78.2			3.40		4.4						
15/11/13	0930-0949	25/Fine	Surface	25.5	24.7	24.7	5.87	5.86	5.93	83.2	83.1	3.99	4.00	4.8	4.9	4.7		
					24.7		82.9			4.01		5.0						
					24.7		82.9			4.01		5.0						
18/11/13	1130-1144	25/Fine	Middle	25.4	24.8	24.8	6.01	6.00	5.89	85.3	85.2	3.22	3.24	4.2	4.3	4.6		
					24.8		85.0			3.25		4.4						
					24.7		85.0			3.25		4.4						
18/11/13	1130-1144	25/Fine	Bottom	25.2	24.8	24.9	5.79	5.80	5.80	82.2	82.3	3.43	3.44	4.6	4.5	4.5		
					24.9		82.3			3.45		4.4						
					24.8		82.3			3.45		4.4						
18/11/13	1130-1144	25/Fine	Surface	25.5	24.6	24.7	5.90	5.91	5.96	83.5	83.7	3.88	3.87	4.8	4.7	4.7		
					24.7		83.9			3.86		4.6						
					24.8		83.9			3.86		4.6						
18/11/13	1130-1144	25/Fine	Middle	25.7	24.8	24.8	6.00	6.02	5.81	85.0	85.2	3.13	3.12	4.2	4.1	4.4		
					24.7		85.4			3.11		4.0						
					24.7		85.4			3.11		4.0						
18/11/13	1130-1144	25/Fine	Bottom	25.5	24.8	24.9	5.80	5.81	5.81	82.2	82.4	3.34	3.35	4.2	4.3	4.3		
					24.9		82.5			3.36		4.4						
					24.8		82.5			3.36		4.4						
18/11/13	1130-1144	25/Fine	Surface	25.5	25.2	25.2	6.11	6.11	6.03	85.3	85.2	3.23	3.25	4.2	4.2	4.5		
					25.1		85.1			3.27		4.4						
					25.3		85.1			3.27		4.4						
18/11/13	1130-1144	25/Fine	Middle	25.4	25.3	25.3	5.95	5.96	5.82	83.0	83.2	3.52	3.54	4.6	4.5	4.5		
					25.3		83.3			3.56		4.6						
					25.4		83.3			3.56		4.6						
18/11/13	1130-1144	25/Fine	Bottom	25.3	25.4	25.4	5.84	5.82	5.82	81.5	81.2	3.62	3.65	4.8	4.7	4.7		
					25.4		80.9			3.68		4.6						
					25.4		80.9			3.68		4.6						
18/11/13	1130-1144	25/Fine	Surface	25.5	25.3	25.3	5.98	6.00	5.88	83.4	83.6	2.93	2.96	3.8	3.9	3.9		
					25.2		83.8			2.99		4.0						
					25.4		83.8			2.99		4.0						
18/11/13	1130-1144	25/Fine	Middle	25.4	25.4	25.5	5.73	5.76	3.06	79.9	80.3	3.05	3.07	4.2	4.1	4.1		
					25.5		80.7			3.08		4.0						
					25.5		80.7			3.08		4.0						
18/11/13	1130-1144	25/Fine	Bottom	25.3	25.5	25.6	5.83	5.84	5.84	81.2	81.4	3.19	3.16	4.2	4.3	4.3		
					25.6		81.5			3.13		4.4						
					25.3		81.5			3.13		4.4						
18/11/13	1130-1144	25/Fine	Surface	25.5	25.3	25.3	5.99	5.98	5.87	83.7	83.6	2.91	2.92	3.8	3.9	3.9		
					25.2		83.4			2.93		4.0						
					25.4		83.4			2.93		4.0						
18/11/13	1130-1144	25/Fine	Middle	25.4	25.4	25.4	5.76	5.76	2.92	80.6	80.5	2.84	2.85	3.6	3.8	3.9		
					25.4		80.4			2.85		4.0						
					25.5		80.4			2.85		4.0						
18/11/13	1130-1144	25/Fine	Bottom	25.2	25.5	25.5	5.83	5.84	5.84	81.7	81.9	2.99	3.00	4.0	3.9	3.9		
					25.4		82.0			3.01		3.8						
					25.5		82.0			3.01		3.8						
18/11/13	1130-1144	25/Fine	Surface	25.5	25.1	25.1	6.04	6.03	5.89	84.5	84.4	2.91	2.92	4.0	3.9	3.9		
					25.1		84.2			2.93		3.8						
					25.3		84.2			2.93		3.8						
18/11/13	1130-1144	25/Fine	Middle	25.4	25.3	25.4	5.74	5.75	2.90	80.4	80.5	2.79	2.80	3.6	3.7	3.9		
					25.4		80.6			2.81		3.8						
					25.5		80.6			2.81		3.8						
18/11/13	1130-1144	25/Fine	Bottom	25.2	25.5	25.5	5.84	5.85	5.85	82.1	82.2	2.97	2.98	4.0	4.1	4.1		
					25.4		82.3			2.99		4.2						
					25.4		82.3			2.99		4.2						



**Monitoring Station : TKO-C1**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	1230-1244	22/Cloudy	Surface	23.5	25.2	6.08	6.07	80.9	80.8	2.90	2.91	3.8	3.9	3.8			
				23.6	25.3	6.06	6.07	80.6	80.8	2.92	2.91	4.0	4.0				
			Middle	23.6	25.4	5.84	5.85	77.8	78.0	2.78	2.79	3.6	3.7				
				23.6	25.3	5.86	5.85	78.1	78.0	2.80	2.79	3.8	3.8				
			Bottom	23.6	25.4	5.94	5.95	79.2	79.3	2.95	2.96	4.0	3.9				
				23.0	25.5	5.96	5.95	79.4	79.3	2.97	2.96	3.8	3.8				
22/11/13	1330-1350	22/Cloudy	Surface	23.0	28.1	6.62	6.60	92.2	91.8	3.26	3.29	4.2	4.3	4.5			
				23.0	28.1	6.58	6.60	91.4	91.8	3.31	3.29	4.4	4.4				
			Middle	23.0	28.2	6.47	6.44	90.8	90.5	3.45	3.48	4.4	4.5				
				23.0	28.2	6.41	6.44	90.2	90.5	3.50	3.48	4.6	4.6				
			Bottom	23.0	28.2	6.40	6.38	90.1	89.9	3.61	3.64	4.6	4.7				
				23.3	28.2	6.35	6.38	89.7	89.9	3.66	3.64	4.8	4.8				
25/11/13	1700-1715	20/Fine	Surface	23.3	25.2	6.07	6.05	80.7	80.5	3.24	3.22	4.2	4.1	4.3			
				23.2	25.3	6.03	6.05	80.2	80.5	3.20	3.22	4.0	4.0				
			Middle	23.2	25.4	6.18	6.15	82.2	81.8	3.54	3.56	4.2	4.3				
				23.1	25.4	6.12	6.15	81.4	81.8	3.58	3.56	4.4	4.4				
			Bottom	23.1	25.5	6.03	6.02	80.2	80.1	3.47	3.45	4.4	4.5				
				23.3	25.6	6.01	6.02	79.9	80.1	3.43	3.45	4.6	4.6				
27/11/13	1900-1915	21/Cloudy	Surface	23.1	25.2	6.11	6.09	81.2	81.0	3.21	3.19	4.2	4.1	4.3			
				23.0	25.3	6.07	6.09	80.7	81.0	3.17	3.19	4.0	4.0				
			Middle	23.0	25.4	6.22	6.19	82.7	82.3	3.51	3.47	4.6	4.5				
				22.9	25.3	6.16	6.19	81.8	82.3	3.43	3.47	4.4	4.4				
			Bottom	22.9	25.6	6.06	6.06	80.5	80.4	3.32	3.30	4.4	4.3				
				21.6	25.6	6.05	6.06	80.3	80.4	3.28	3.30	4.2	4.2				
29/11/13	0800-0815	20/Cloudy	Surface	21.6	24.9	6.12	6.11	80.0	79.9	3.17	3.21	4.0	4.1	4.3			
				21.7	25.0	6.10	6.11	79.8	79.9	3.24	3.21	4.2	4.2				
			Middle	21.7	25.2	6.27	6.25	82.0	81.8	3.12	3.13	4.2	4.1				
				21.8	25.1	6.23	6.25	81.5	81.8	3.14	3.13	4.0	4.0				
			Bottom	21.8	25.2	6.12	6.15	80.0	80.4	3.58	3.55	4.6	4.6				
				21.8	25.3	6.18	6.15	80.8	80.4	3.52	3.55	4.8	4.8				



**Monitoring Station : TKO-M4**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average
01/11/13	1118-1130	26/Fine	Surface	1.0	25.6	26.6	26.6	5.78	5.77	81.0	80.8	2.86	2.85	3.6	3.8	4.1			
			Middle	4.6	25.5	26.5	26.7	5.76	5.59	80.6	78.2	2.84	3.01	4.0	4.1				
			Bottom	8.2	25.3	26.7	26.8	5.57	5.62	78.0	78.6	3.00	3.18	4.2	4.4				
04/11/13	1315-1330	22/Cloudy	Surface	1.0	25.8	24.6	24.6	5.61	6.11	78.5	86.6	3.17	3.25	4.4	4.3	4.5			
			Middle	4.2	25.8	24.6	24.7	6.10	5.87	86.7	83.3	3.24	3.49	4.4	4.5				
			Bottom	7.4	25.7	24.7	24.9	5.86	5.62	83.1	79.8	3.48	3.65	4.6	4.8				
06/11/13	1440-1500	26/Cloudy	Surface	1.0	25.9	24.6	24.7	5.83	5.97	79.9	84.6	3.67	3.13	4.2	4.1	4.5			
			Middle	4.2	25.8	24.8	24.8	5.96	5.55	84.5	78.7	3.11	3.42	4.2	4.6				
			Bottom	7.3	25.6	24.8	24.9	5.98	5.68	84.7	80.6	3.41	3.50	4.4	4.7				
08/11/13	1640-1700	26/Cloudy	Surface	1.0	25.7	24.6	24.6	5.61	5.97	80.7	84.6	3.51	3.00	3.8	3.9	4.3			
			Middle	4.3	25.6	24.7	24.7	5.96	5.60	80.5	79.3	2.99	3.30	4.0	4.3				
			Bottom	7.6	25.5	24.6	24.8	5.58	5.69	79.1	80.7	3.28	3.41	4.4	4.6				
11/11/13	1942-2000	25/Cloudy	Surface	1.0	25.6	25.2	25.2	5.61	6.05	79.4	84.4	3.39	3.39	4.4	4.4	4.6			
			Middle	4.2	25.5	25.3	25.3	5.68	5.92	80.8	82.6	3.43	3.62	4.4	4.7				
			Bottom	7.4	25.4	25.4	25.4	5.70	5.73	80.5	80.0	3.39	3.72	4.6	4.8				
13/11/13	0935-100	25/Cloudy	Surface	1.0	25.4	25.4	25.4	5.72	5.85	79.8	81.6	3.70	3.16	4.2	4.3	4.5			
			Middle	4.2	25.3	25.6	25.6	5.83	5.63	81.3	78.5	3.15	3.37	4.2	4.5				
			Bottom	7.4	25.2	25.7	25.7	5.87	5.77	81.9	80.4	3.17	3.55	4.4	4.7				
15/11/13	1110-1130	25/Fine	Surface	1.0	25.6	25.3	25.3	5.76	5.84	80.6	81.5	3.57	3.13	4.2	4.1	4.4			
			Middle	4.3	25.5	25.4	25.4	5.82	5.61	81.3	78.5	3.11	3.33	4.2	4.5				
			Bottom	7.5	25.4	25.5	25.5	5.85	5.73	81.7	80.4	3.14	3.52	4.6	4.6				
18/11/13	1310-1330	25/Fine	Surface	1.0	25.6	25.1	25.2	5.72	5.78	80.2	80.9	3.52	3.12	4.2	4.1	4.4			
			Middle	4.3	25.4	25.3	25.3	5.74	5.65	80.5	79.1	3.11	3.27	4.2	4.4				
			Bottom	7.6	25.3	25.4	25.5	5.77	5.73	80.6	80.5	3.13	3.54	4.4	4.7				

# Mid-Ebb Tide

## Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Value	Average	Depth-average	Value	Average
20/11/13	1410-1430	22/Cloudy	Surface	23.4	25.3	25.4	5.87	5.88	78.2	78.3	3.10	3.11	4.2	4.1	4.4			
			Middle	23.5	25.5	5.68	5.69	78.4	75.8	3.11	3.26	4.0	4.4					
			Bottom	23.5	25.5	5.70	5.77	75.9	76.9	3.27	3.52	4.4	4.4					
22/11/13	1506-1530	22/Cloudy	Surface	22.8	28.5	28.5	6.38	6.42	89.8	90.2	3.41	3.45	4.2	4.3	4.6			
			Middle	22.8	28.5	6.45	6.48	90.6	90.8	3.48	3.61	4.4	4.8					
			Bottom	22.8	28.5	6.44	6.30	91.1	89.1	3.59	3.55	4.8	4.6					
25/11/13	1830-1845	20/Fine	Surface	23.3	25.3	25.3	6.26	6.15	88.8	81.8	3.58	3.12	4.0	4.2	4.6			
			Middle	23.2	25.4	6.14	6.28	89.4	83.5	3.52	3.63	4.0	4.8					
			Bottom	23.2	25.6	6.33	6.07	81.1	80.7	3.11	3.85	4.4	4.9					
27/11/13	2040-2100	21/Cloudy	Surface	23.2	25.2	25.2	6.10	6.19	82.4	82.3	3.08	3.09	3.8	3.9	4.5			
			Middle	23.0	25.4	6.18	6.32	82.1	84.0	3.10	3.61	4.0	4.7					
			Bottom	23.0	25.7	6.33	6.11	83.8	81.2	3.58	3.82	4.8	4.9					
29/11/13	0945-1000	20/Cloudy	Surface	21.5	25.0	25.0	6.14	6.41	80.8	83.9	3.79	3.45	4.6	4.6	4.5			
			Middle	21.7	25.1	6.40	6.35	81.6	83.1	3.85	3.49	5.2	4.5					
			Bottom	21.8	25.2	6.37	6.11	84.0	79.8	3.46	3.28	4.4	4.3					

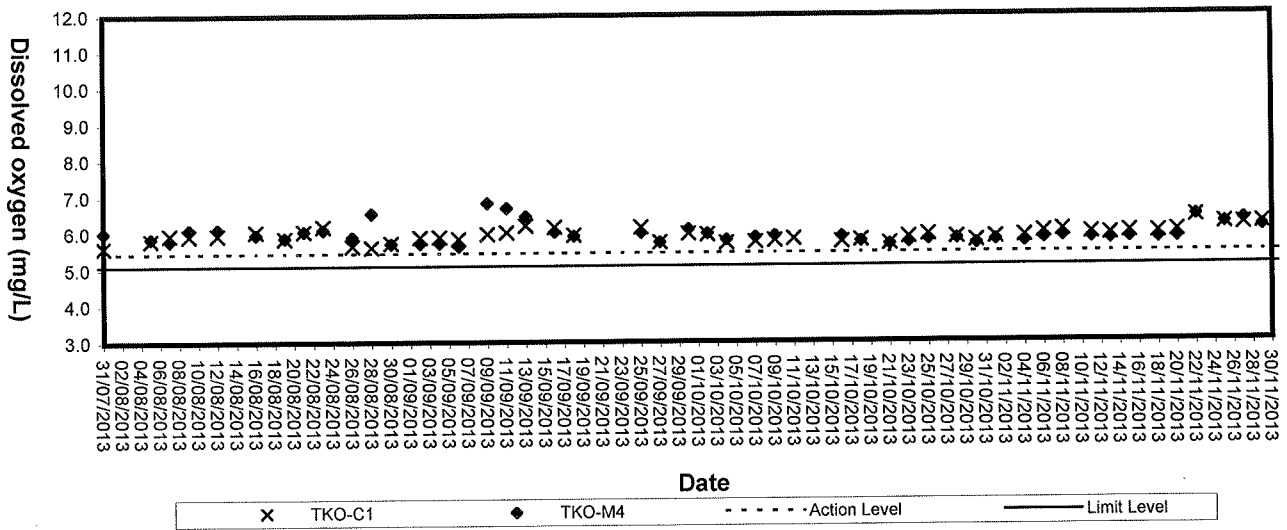
## **Appendix I**

### **D3**


## **Graphical Plots of Impact Marine Water Quality Monitoring Data**



### Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide




### Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

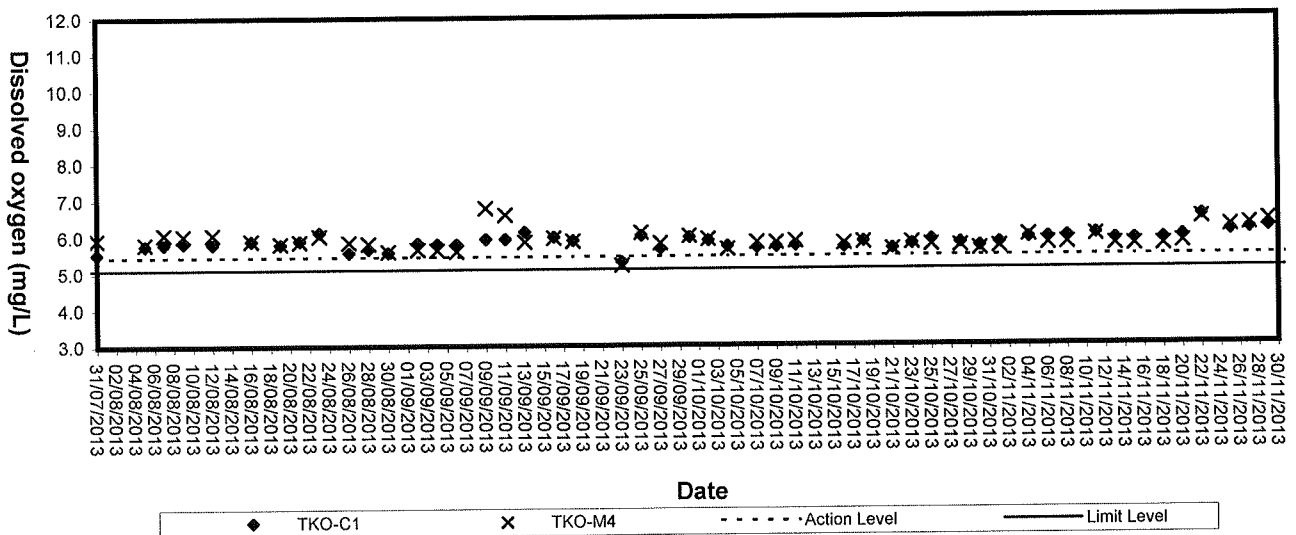




### Dissolved Oxygen (Bottom) at Mid-Flood Tide

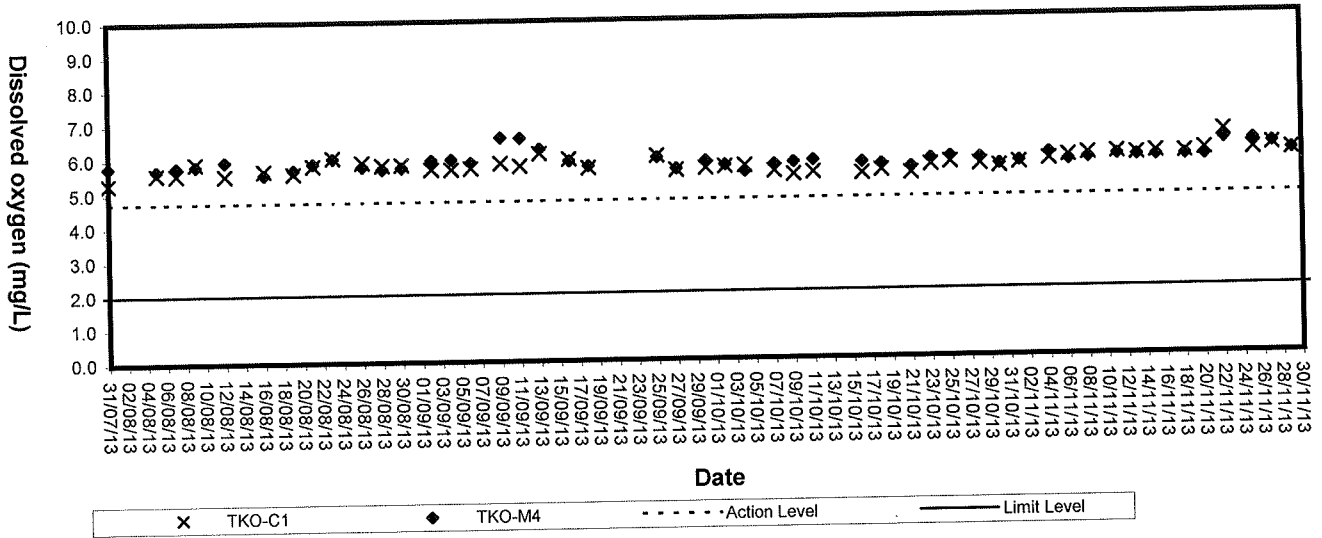


### Dissolved Oxygen (Bottom) at Mid-Ebb Tide

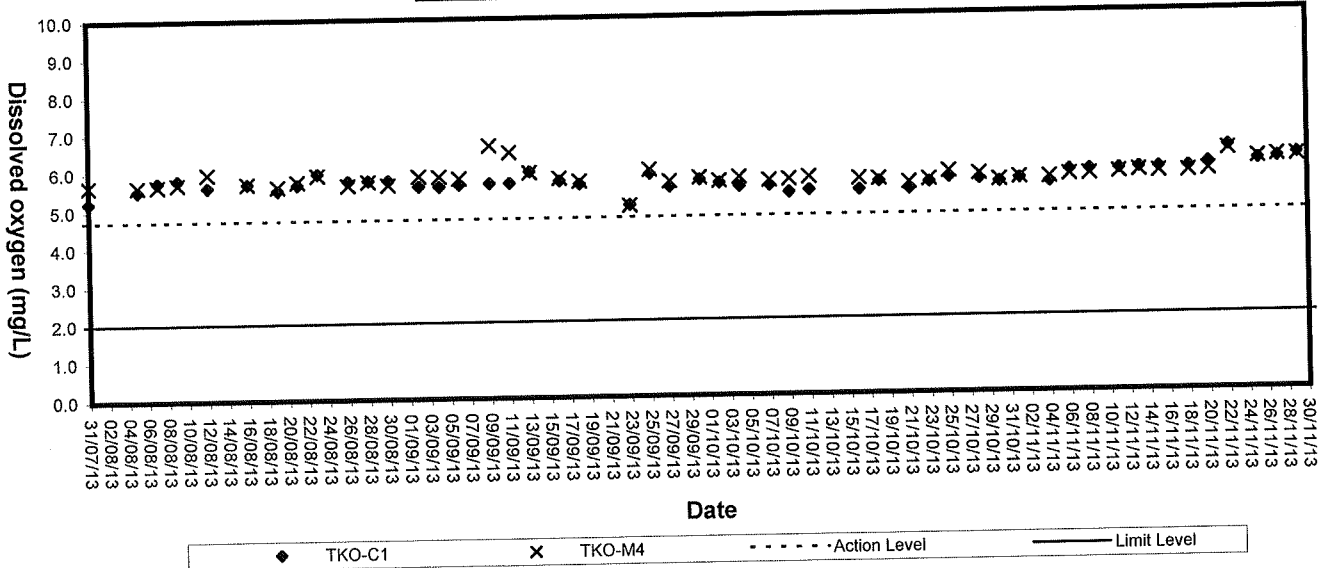




### Turbidity (Depth-average) at Mid-Flood Tide

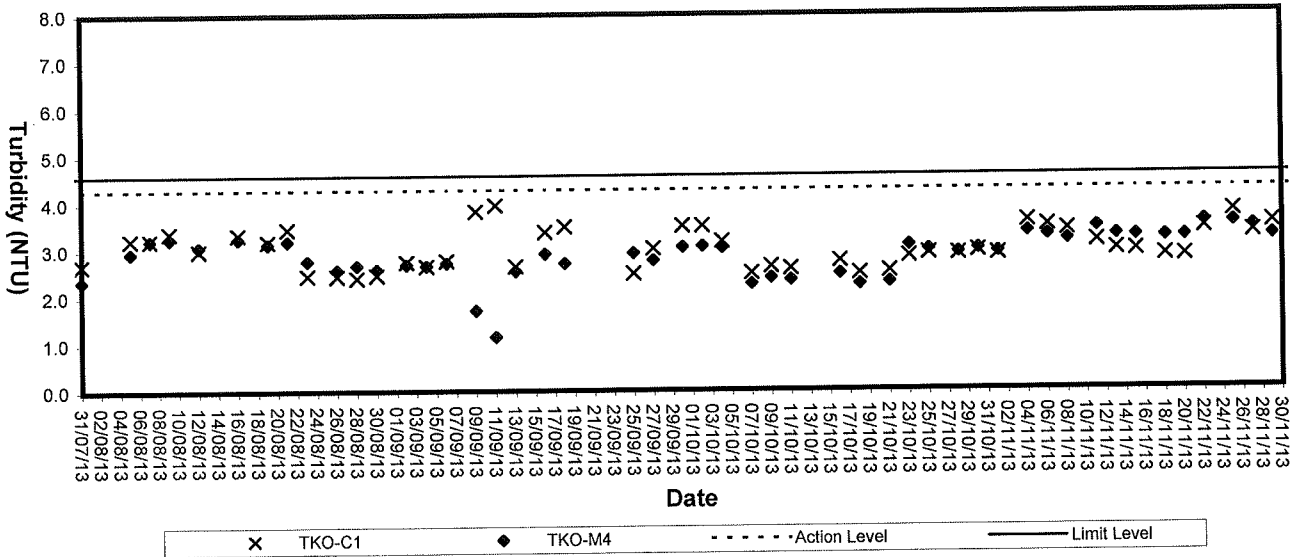


### Turbidity (Depth-average) at Mid-Ebb Tide

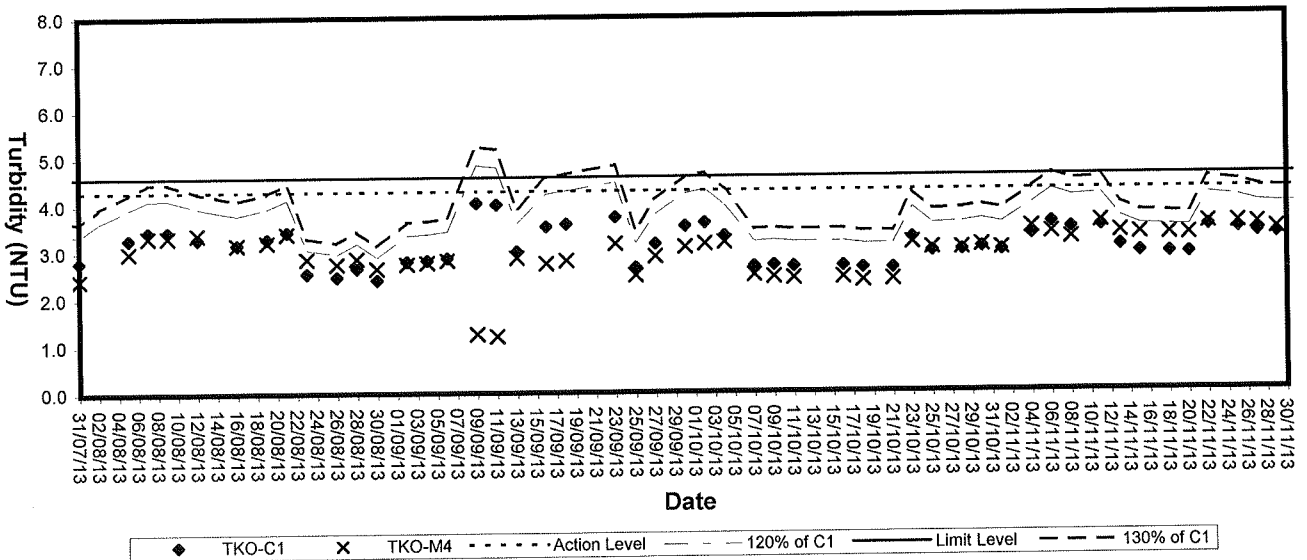




### Suspended solids (Depth-average) at Mid-Flood Tide

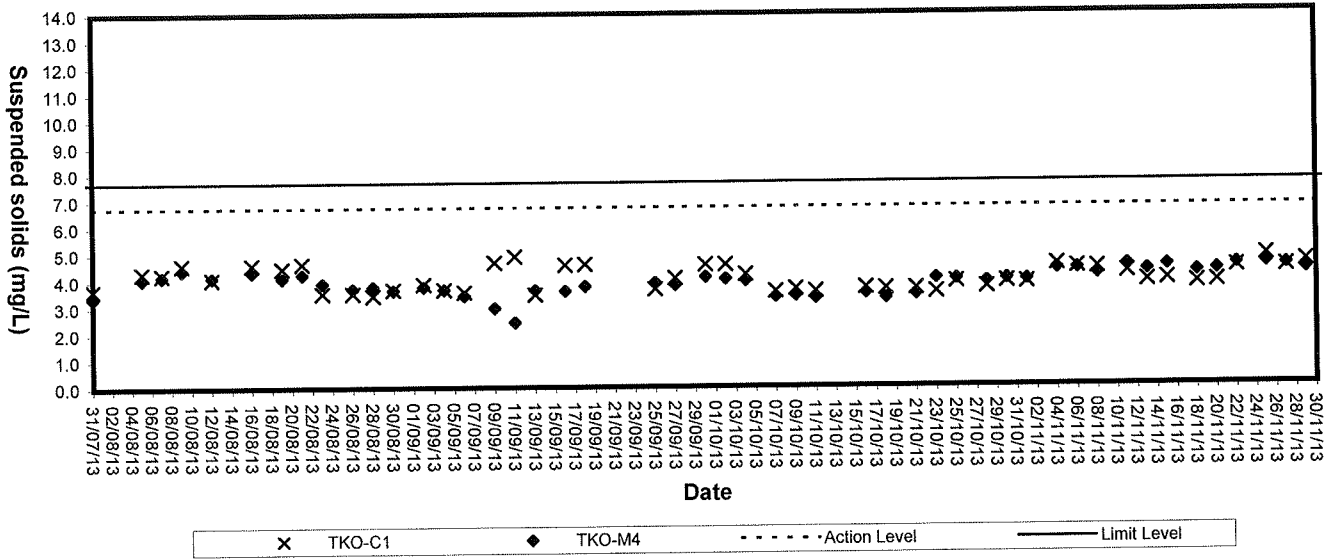

### Suspended Solids (Depth-average) at Mid-Ebb Tide

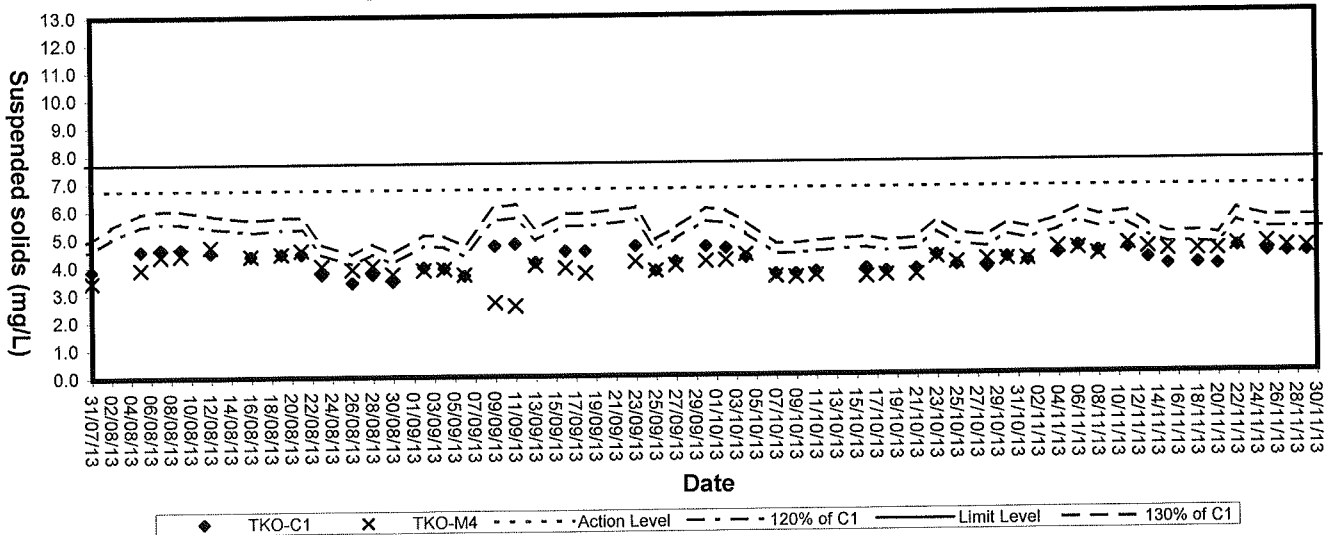



## Appendix I

### E

## Weather Condition



## Extract of Meteorological Observations for Tseung Kwan O Automatic Weather Station, November 2013

Date	Mean Pressure at M.S.L. (hPa)	Air Temperature			Mean Dew Point Temperature (deg C)	Relative Humidity		
		Max. (deg C)	Mean (deg C)	Min. (deg C)		Max. (%)	Mean (%)	Min. (%)
Nov 1	*****	30.6	24.3	19.5	17.9	94	70	37
Nov 2	*****	28.3	25.3	22.6	18.6	78	67	54
Nov 3	*****	27.9	25.0	21.7	19.6	94	73	60
Nov 4	*****	24.8	21.8	20.7	19.9	98	89	74
Nov 5	*****	25.2	22.1	20.4	20.0	98	89	70
Nov 6	*****	28.0	23.4	21.2	20.4	94	84	62
Nov 7	*****	27.5	24.0	22.0	20.1	94	80	62
Nov 8	*****	27.9	23.9	22.1	19.1	91	76	50
Nov 9	*****	28.6	25.4	21.4	20.2	92	73	56
Nov 10	*****	26.5	25.3	24.5	22.0	92	82	72
Nov 11	*****	24.6	23.7	22.6	21.1	93	85	80
Nov 12	*****	22.7	21.7	20.9	20.4	98	92	84
Nov 13	*****	21.0	19.9	19.1	18.6	98	92	83
Nov 14	*****	24.5	20.2	17.8	16.9	93	82	64
Nov 15	*****	26.6	20.6	16.3	16.0	95	77	50
Nov 16	*****	26.0	20.7	17.0	15.4	89	73	49
Nov 17	*****	25.2	20.3	15.8	12.3	79	62	39
Nov 18	*****	25.0	19.5	16.0	9.7	88	56	28
Nov 19	*****	21.7	19.1	16.0	12.2	91	65	47
Nov 20	*****	21.7	19.5	18.2	13.6	77	69	58
Nov 21	*****	23.7	19.8	16.4	13.1	88	66	43
Nov 22	*****	23.9	20.6	18.2	16.3	93	77	56
Nov 23	*****	24.4	21.7	20.2	16.9	86	74	58
Nov 24	*****	28.0	22.4	18.8	19.0	97	82	61
Nov 25	*****	24.2	18.0	14.8	8.7	95	58	28
Nov 26	*****	23.0	18.6	14.7	13.0	85	71	46
Nov 27	*****	24.0	19.9	14.6	15.1	88	75	60
Nov 28	*****	19.3	15.0	12.2	7.5	93	63	35
Nov 29	*****	19.4	13.8#	11.3	-0.2#	64	40#	21
Nov 30	*****	21.1	14.6	10.6	6.1	83	58	35
<b>Mean</b>	*****	24.8	21.0#	18.3	15.7#	90	73#	54
<b>Maximum</b>	*****	30.6	25.4#	24.5	22.0#	98	92#	84
<b>Minimum</b>	*****	19.3	13.8#	10.6	-0.2#	64	40#	21

## Extract of Meteorological Observations for Tseung Kwan O Automatic Weather Station, November 2013

Date	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
Nov 1	0.0	070	5.3
Nov 2	0.0	010	9.0
Nov 3	1.5	010	10.0
Nov 4	17.0	060	7.8
Nov 5	12.5	060	7.0
Nov 6	0.0	070	5.4
Nov 7	0.0	030	7.4
Nov 8	0.0	020	8.6
Nov 9	0.0	030	9.8
Nov 10	2.0	160	8.0
Nov 11	0.0	140	9.5
Nov 12	49.0	050	8.9
Nov 13	9.5	060	7.2
Nov 14	0.0	340	5.8
Nov 15	0.0	070	5.3
Nov 16	0.0	070	6.2
Nov 17	0.0	070	4.8
Nov 18	0.0	070	4.9
Nov 19	0.0	060	4.8
Nov 20	0.0	030	7.9
Nov 21	0.0	030	6.5
Nov 22	0.5	020	8.3
Nov 23	0.0	070	9.9
Nov 24	8.0	030	6.1
Nov 25	0.0	060	8.8
Nov 26	0.0	080	6.3
Nov 27	0.0	070	7.9
Nov 28	4.0	060	10.1
Nov 29	0.0	350	8.8
Nov 30	0.0	070	4.2
<b>Mean</b>	-----	070	7.3
<b>Total</b>	104.0	---	-----
<b>Maximum</b>	49.0	---	10.1
<b>Minimum</b>	0.0	---	4.2

\*\*\* unavailable

# missing (less than 24 hourly observations a day)

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected

**Appendix I**

**F**

**Event-Action Plans**

## EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

ACTION

IC(E)

ER

Contractor

ACTION LEVEL

LIMIT LEVEL

EVENT	ET Leader	IC(E)	ER	Contractor
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>Inform ER, IC(E) and Contractor</li> <li>Repeat measurement to confirm finding</li> <li>Increase monitoring frequency to daily</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by the ET</li> <li>Check contractor's working method</li> </ol>	<ol style="list-style-type: none"> <li>Notify Contractor</li> </ol>	<ol style="list-style-type: none"> <li>Rectify any unacceptable practise</li> <li>Amend working methods if appropriate</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>Inform IC(E) and Contractor</li> <li>Repeat measurements to confirm finding</li> <li>Increase monitoring frequency to daily</li> <li>Discuss with IC(E) and Contractor on remedial actions</li> <li>If exceedance continues, arrange meeting with IC(E) and ER.</li> <li>If exceedance stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by the ET</li> <li>Leader</li> <li>Check the Contractor's working method</li> <li>Discuss with ET and Contractor on possible remedial measures</li> <li>Advise the ER on the effectiveness of the proposed remedial measures</li> <li>Supervise implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of failure in writing</li> <li>Notify the Contractor</li> <li>Ensure remedial measures properly implemented</li> </ol>	<ol style="list-style-type: none"> <li>Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>Implement the agreed proposals</li> <li>Amend proposal if appropriate</li> </ol>
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>Inform ER, Contractor and EPD</li> <li>Repeat measurement to confirm finding</li> <li>Increase monitoring frequency to daily</li> <li>Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by the ET</li> <li>Leader</li> <li>Check Contractor's working method</li> <li>Discuss with ET and Contractor on possible remedial measures</li> <li>Advise the ER on the effectiveness of the proposed remedial measures</li> <li>Supervise implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of failure in writing</li> <li>Notify the Contractor</li> <li>Ensure remedial measures properly implemented</li> </ol>	<ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance</li> <li>Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>Implement the agreed proposals</li> <li>Amend proposal if appropriate.</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY

Event	ACTION			
	ET Leader	Contractor	ER	IEC
<p>Action level being exceeded by more than one consecutive sampling days</p>	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Repeat in-situ measurement to confirm findings</li> <li>3. Notify Contractor in writing within 24 hours of identification</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Prepare to increase the monitoring frequency to daily;</li> <li>10. Repeat measurement on next day of exceedance.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify IEC and ER in writing within 24 hours of identification of exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the mitigation measure</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>

## EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ACTION			
	ET Leader	IC(E)	ER	Contractor
<p>2. Exceedance for two or more consecutive samples</p>	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Notify IC(E), ER, EPD and Contractor</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented</li> <li>6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> <li>8. If exceedance stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET and Contractor on the potential remedial actions</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly</li> <li>3. Supervise the implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify Contractor</li> <li>3. In consultation with the Contractor on agree with the Contractor on the remedial measures to be implemented</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedances</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Resubmit proposals if problem still not under control</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedance is abated</li> </ol>

## EVENT/ACTION PLAN FOR NOISE EXCEEDANCE

EVENT	ACTION			
	ET Leader	IC(E)	ER	Contractor
Action Level	<ol style="list-style-type: none"> <li>1. Notify the IC(E) and the Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to the IC(E) and the Contractor.</li> <li>4. Discuss with the Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IC(E).</li> <li>2. Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol style="list-style-type: none"> <li>1. Notify the IC(E), the ER, the EPD and the Contractor.</li> <li>2. Identify source.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform the IC(E), the ER and the EPD the causes &amp; actions taken for the exceedances.</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results</li> <li>8. If exceedance due to the construction works stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Resubmit proposals if problem still not under control.</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
<p>Action level being exceeded by one sampling day</p>	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Repeat in-situ measurement to confirm findings;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days</li> <li>8. Repeat measurement on next day of exceedance if exceedance is due to the construction works</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify the ER and IEC in writing within 24 hours of identification of exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance</li> <li>5. Consider changes of working method if exceedance is due to the construction works</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the mitigation measure</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures</li> <li>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>5. Supervise the implementation of mitigation measures</li> </ol>



## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION		
	ET Leader	Contractor	ER IEC
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC, ER and Contractor within 4 working of identification of an exceedance</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Increase the monitoring frequency to daily until no exceedance of Limit Level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify IEC and ER in writing; within 24 hours of the identification of the exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to critically review the working methods;</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>
			<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>5. Assess the effectiveness of the implemented mitigation measures</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION		
	ET Leader	Contractor	ER
Limit Level being exceeded by more than one consecutive sampling days	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC, ER and Contractor;</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify ER and IEC in writing within 24 hours of the identification of the exceedance and Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>8. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days;</li> <li>6. Implement the agreed mitigation measures within reasonable time scale</li> <li>7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to critically review the working methods;</li> <li>6. Ensure remedial measures are properly implemented</li> <li>4. Assess the effectiveness of the implemented mitigation measures;</li> <li>5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level.</li> </ol>
			IEC
			<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ER, ET and Contractor on the mitigation measures.</li> <li>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>



## **Appendix I**

### **G**

## **Works Programme**

Master Programme of Contract No. CV/2009/02 - Handling of Surplus Public Fill

Site Location : Tseung Kwan O Area 137 Fill Bank

ID	Activity	Original Duration	Start	Finish
S101000	Taking Over the Existing Facilities	0	19/01/2010	
S102000	Operation	1096	19/01/2010	18/01/2013
S103000	Operation and Maintenance of Tipping Halls	1096	19/01/2010	18/01/2013
S104000	Provision and Operation of a Crushing Plant	1096	19/01/2010	18/01/2013
S105000	Handing Over the Facilities to the Employer	0		18/01/2013
A101000	Removal of Stockpile Area A3	100	19/01/2010	28/04/2010
A102000	Site Formation	7	22/04/2010	28/04/2010
A103000	Provision of New Combined Reception and Exit Offices	90	29/04/2010	27/07/2010
A104000	Provision of Inspection Platform	60	28/07/2010	25/09/2010
A105000	Provision of Measurement Systems	60	28/07/2010	25/09/2010
A106000	Provision of Surveillance Systems	60	28/07/2010	25/09/2010
A107000	Provision of Wheel Washing Facilities	60	28/07/2010	25/09/2010
A109000	Testing, Commissioning & Handover	21	14/09/2010	10/04/2010
A109100	Removal of Existing Combined Reception & Exit Offices & other Facilities A3	14	10/05/2010	18/10/2010
A109200	Removal of Existing Combined Reception & Exit Offices & other Facilities A6	14	10/05/2010	18/10/2010
A201000	Removal of Stockpile Area at Portion A6	316	19/01/2010	30/11/2010
A209100	Construction of Access Road at Portion A6	60	20/10/2010	18/12/2010
A209200	Construction of Access Road at Portion A3	61	19/10/2010	18/12/2010



## Appendix I

### H

## IEC's Site Audit Records

<b>Project:</b>	Contract No.: CV/2009/02	<b>Checklist No.:</b>	CEDPFRSFEM00_131106_TKOFB
	Handling of Surplus Public Fill	<b>Inspected by:</b>	
<b>Inspection</b>		<b>CEDD:</b>	CK WOO
<b>Date:</b>	6 November 2013	<b>IEC:</b>	JASON LAM
<b>Time:</b>	10:30	<b>ET:</b>	KW MAK
<b>Location:</b>	TKO Area 137	<b>Contractor:</b>	SW SUNG

**PART A: GENERAL INFORMATION**

Weather:  Sunny  Fine  Cloudy  Rainy

Temperature: 24 °C

Humidity:  High  Moderate  Low

Wind:  Strong  Breeze  Light  Calm

**PART B: SITE AUDIT**

Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
----------	-----	----	-----------	-----	---------------

**Section 1: Water Quality**

1.01	Is an effluent discharge license obtained for the Project?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.02	Is the effluent discharged in accordance with the discharge licence?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.03	Is the discharge of turbid water avoided?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.04	Are temporary intercepting drains provided at the stockpiling area to divert polluted stormwater to the intercepting channels?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.05	Are all catchpits, sand and silt removal facilities, and the drainage and intercepting channels on site properly maintained?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.06	Is the stormwater intercepting system effective to collect of runoff and remove suspended solids before discharge?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.07	Is water retained in receptacles and standing water avoided to prevent mosquito breeding?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.08	Is the material properly covered to prevent washed away especially before rainstorm?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.09	Is the temporary slope surface covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD when rainstorm is imminent or forecast?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.10	Is the final slope surface treated by compaction, followed by hydroseeding or other suitable surface stabiliser approved by CEDD to prevent washing away of stockpiled material?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.11	Is a wheel washing bay with high pressure water jets provided at the site exit?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.12	Is sand and silt settled out or removed before being discharged into storm drains?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.13	Are the manholes covered and sealed?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.14	Is sewage from toilets discharged in to a foul sewer, or chemical toilets provided?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.15	Is sewage from chemical toilets collected by a licensed contractor for disposal and maintenance of these facilities?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.16	Are tipping halls enclosed with top and 3-sides to prevent spillage of material into marine water?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Obs ②: p4
1.17	Is silt curtain provided at the outward side at the TKO basin near the barging point?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Obs ①: p3
1.18	Is a waste collection vessel deployed to remove floating debris?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.19	Is foam, oil, grease, scum, litter or other objectionable matters avoided on the water in vicinity of the barging facilities during the work activities?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.20	Are the barges in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller washing?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

	Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
1.21	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.22	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.23	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.24	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.25	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.26	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.27	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.28	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.29	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
<b>Section 2: Air Quality</b>						
2.01	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.02	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.03	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.04	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.05	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.06	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.07	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.08	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.09	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.10	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.11	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.12	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.13	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.14	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.15	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.16	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.17	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.18	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.19	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.20	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

		Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
2.21	Is a buffer zone of at least 100m provided between the edge of the stockpiling area and the TVB Broadcast and production Centre in the TKO Industrial Estate?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.22	Is site fencing of 2.4m high erected along the entire northern boundary of the site?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<b>Section 3: Noise</b>							
3.01	Are the approved method of working, equipment and sound reducing measures adopted?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.02	Are the site activities scheduled to minimize noise nuisance?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.03	Are all plants well maintained and in good condition?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.04	Are the Powered mechanical plant (PME) covered or shielded by appropriate acoustic materials?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.05	Are air compressors and hand held breakers fitted with valid noise emission labels during operation?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.06	Are the compressors and generators operated with door closed?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.07	Are idle machines and plants shut down or throttled down?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.08	Are noisy equipment and mobile plant sited away from NSRs?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.09	Are the works within 10m from the western boundary of the Clearwater Bay Country Park not allowed?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.10	Is the operation hours of the fill bank restricted to 8:00 a.m. to 11:00 p.m.?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<b>Section 4: Waste/Chemical Management</b>							
4.01	Are recycle bins for paper, plastic bottles and aluminium cans provided at the site office area?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.02	Are the recyclable wastes reused on site or collected by the licensed waste recycling agents?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.03	Is relevant license/permit for disposal of construction waste or excavated material, if generated from the site, available for inspection?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.04	Is excavated material, if generated from the site, reused on-site?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
4.05	Is mud and debris removed from waterworks access roads and associated drainage systems?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.06	Is sufficient waste disposal points and regular collection for disposal provided?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.07	Are appropriate measures employed to minimize windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.08	Is there any segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.09	Is the disposal of C&D waste, recyclable materials salvaged for reuse and inert waste utilised as public fill to minimize the quality of waste to be disposed of to landfill?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.10	Is trip ticket system implemented for the disposal of construction wastes, in order to monitor the disposal of C&D material and solid wastes at public filling areas and landfills, and to control fly-tipping?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.11	Is soil contaminated with chemicals/oils removed from site and the void created shall be filled with suitable materials?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.12	Is the Contractor registered as a chemical waste producer? The waste Disposal Ordinance (Cap354) and its subsidiary regulations in particular the waste disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.13	Are chemical wastes handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical wastes after use?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	



	Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
4.14	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.15	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.16	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.17	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.18	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.19	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.20	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.21	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.22	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.23	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.24	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.25	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.26	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.27	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.28	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.29	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.30	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.31	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.32	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.33	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<b>Section 5: Landscape &amp; Visual</b>						
5.01	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.02	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.03	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.04	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.05	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
----------	-----	----	-----------	-----	---------------

**Section 6: Others**

6.01	Is the fill bank site restricted access by the general public?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
6.02	Is environmental permit displaced conspicuously on site?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

**Section 7: Follow-up for the Previous Environmental Inspection on date** 18.10.2013 (Ref No. CEDPFRSFEM00\_131018\_TKOFB)

Is the situation in item <u>Fu①</u> improved / rectified?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<u>closed; p2</u>
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

**Remarks:**

Follow-up:

- Fu①. Housekeeping for chemical storage had been improved. (closed)

New observation:

- obs①, silt curtain near the Tipping Hall NO.1 is damaged.
- obs②, cladding of tipping hall NO.2 is damaged.

Signature: CEDD's Representative	Signature: IEC Auditor	Signature: ET Auditor	Signature: Contractor's Representative
	<u>Jason</u>	<u>Mark</u>	
Name: _____	Name: <u>K CUM</u>	Name: <u>Mark Kei Wai</u>	Name: <u>S. Y. S. W. L.</u>
Date: <u>6-11-2013</u>	Date: <u>6.11.2013</u>	Date: <u>6/11/13</u>	Date: <u>6/11/2013</u>

Contract No.: CV/2009/02

Inspection Date: 6 November 2013

(1) Follow-up the previous inspection

Checklist No.: CEDPFRSFEM00\_131018\_TKOFB

Before

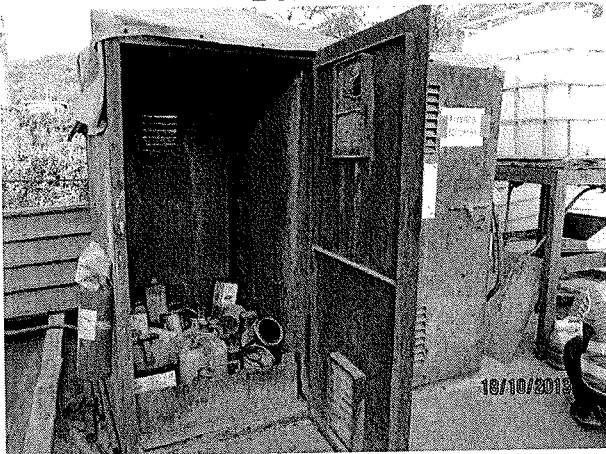


Photo 1

Chemical Storage Area

Housekeeping for chemical storage should be improved and kept tidy.

The Contractor is reminded to tidy up the chemical storage area.

After

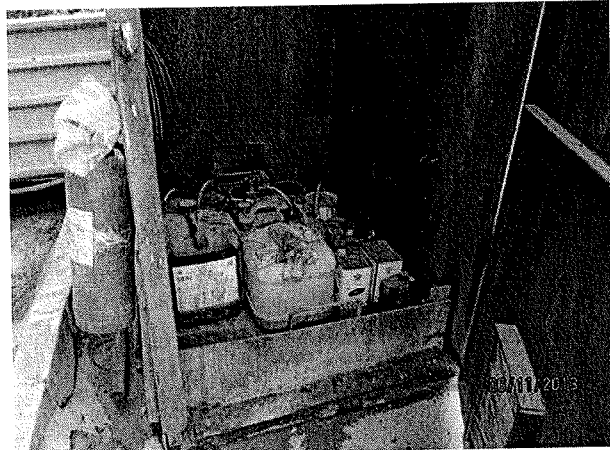


Photo 2

Chemical Storage Area

Housekeeping for chemical storage had been improved. (Closed)

(2) Observation during site inspection

Checklist No.: CEDPFRSFEM00\_131106\_TKOFB



Photo 3

Silt Curtain

Silt curtain near the Tipping Hall No.1 is damaged.

The Contractor is reminded to replace the damaged silt curtain as soon as possible.



Photo 4

Tipping Hall No.2

Cladding of tipping hall is damaged.

The Contractor is reminded to repair the damaged part of tipping hall.

Project: Contract No.: CV/2009/02  
Handling of Surplus Public Fill

Inspection

Date: 25 November 2013

Time: 10:20

Location: TKO Area 137

Checklist No. CEDPFRSFEM00\_131125\_TKOFB

Inspected by \_\_\_\_\_

CEDD: CKWoo

IEC: JASON LAI

ET: KW MAK

Contractor: SW SUNG

**PART A: GENERAL INFORMATION**

Weather:  Sunny  Fine  Cloudy  Rainy

Temperature: 21 °C

Humidity:  High  Moderate  Low

Wind:  Strong  Breeze  Light  Calm

**PART B: SITE AUDIT**

Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
----------	-----	----	-----------	-----	---------------

**Section 1: Water Quality**

1.01	Is an effluent discharge license obtained for the Project?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.02	Is the effluent discharged in accordance with the discharge licence?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.03	Is the discharge of turbid water avoided?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.04	Are temporary intercepting drains provided at the stockpiling area to divert polluted stormwater to the intercepting channels?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.05	Are all catchpits, sand and silt removal facilities, and the drainage and intercepting channels on site properly maintained?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.06	Is the stormwater intercepting system effective to collect of runoff and remove suspended solids before discharge?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.07	Is water retained in receptacles and standing water avoided to prevent mosquito breeding?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.08	Is the material properly covered to prevent washed away especially before rainstorm?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.09	Is the temporary slope surface covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD when rainstorm is imminent or forecast?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.10	Is the final slope surface treated by compaction, followed by hydroseeding or other suitable surface stabiliser approved by CEDD to prevent washing away of stockpiled material?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.11	Is a wheel washing bay with high pressure water jets provided at the site exit?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.12	Is sand and silt settled out or removed before being discharged into storm drains?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.13	Are the manholes covered and sealed?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.14	Is sewage from toilets discharged in to a foul sewer, or chemical toilets provided?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.15	Is sewage from chemical toilets collected by a licensed contractor for disposal and maintenance of these facilities?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.16	Are tipping halls enclosed with top and 3-sides to prevent spillage of material into marine water?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<u>Fu②.p4</u>
1.17	Is silt curtain provided at the outward side at the TKO basin near the barging point?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<u>Fu①.p2</u>
1.18	Is a waste collection vessel deployed to remove floating debris?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.19	Is foam, oil, grease, scum, litter or other objectionable matters avoided on the water in vicinity of the barging facilities during the work activities?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.20	Are the barges in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller washing?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

		Not Obs.	Yes	No	Follow up	N/A	Photo/ Remarks
1.21	Are all vessels used for transportation of fill material provided with tight fitting seals to their bottom openings to prevent leakage of material during transport?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.22	Are barges not be filled to a level which may cause the overflow of material during loading or transportation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.23	Is barge effluent properly collected and treated before disposal?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.24	Are adequate environmental control measures provided to prevent/ avoid dropping of fill material into the sea during the transfer?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.25	Is there any buffer distance at least 100m maintained between the boundary of the public fill stockpiling area and the sea front?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.26	Is oil intercept in addition of sand/silt removal facilities provided at the car parking area?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.27	Is oil interceptor provided at workshop?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.28	Is oil leakage prevented from all generator, fuel and oil storage?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
1.29	Is wastewater collected from canteen kitchens, including that from basins, sinks and floor drains properly discharged into foul sewers via grease traps?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
<b>Section 2: Air Quality</b>							
2.01	Is dust control/ mitigation measures implemented to prevent dust nuisance?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.02	Are water sprays provided and used to dampen materials?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.03	Are all vehicles restricted to maximum speed 10km per hour?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.04	Is the load on vehicles watered and covered entirely by clean impervious sheeting?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.05	Is the loading of materials to a level higher than the side and tail boards during transportation by vehicles avoided?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.06	Are the unpaved areas watered regularly to avoid dust generation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.07	Are the worksites with active dusty operations watered regularly (at least three times per day) to avoid dust generation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.08	Is the designated site main haul road watered regularly (at least three times per day)?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.09	Is the haul road inside the site and public road around the site entrance kept clean and free from dust?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.10	Is the site haul road covered with concrete, bituminous materials, hardcores or metal plates?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.11	Are there any wheel washing facilities including high-pressure water jet provided at the entrance of work site?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.12	Are vehicles washed to remove any dusty materials from its bodies and wheels before leaving the fill bank?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.13	Are the vehicles and equipments switched off while not in use?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.14	Are all plants and equipments well maintained? (e.g. without black smoke emission)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.15	Is the open burning prohibited?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.16	Is regular cleaning and watering the site provided to minimise the fugitive dust emissions?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.17	Is the temporary slope surface covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.18	Is the final slope surface treated by compaction, followed by hydroseeding or other suitable surface stabiliser approved by CEDD?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.19	Are conveyor belts, conveyor transfer points and hopper discharge areas fitted with windboards, belt cleaners or enclosed?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.20	Are belt scraper installed and equipped with bottom plates to prevent falling of material from the return belt?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

	Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
2.21	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
2.22	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<b>Section 3: Noise</b>						
3.01	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.02	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.03	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.04	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.05	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.06	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.07	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.08	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.09	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
3.10	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<b>Section 4: Waste/Chemical Management</b>						
4.01	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.02	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.03	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.04	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
4.05	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.06	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.07	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.08	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.09	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.10	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.11	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.12	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.13	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

		Not Obs.	Yes	No	Follow up	N/A	Photo/ Remarks
4.14	Are the chemical wastes separated for special handling and appropriate treatment at the Chemical Waste Treatment Facility?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.15	Are chemical wastes including waste oil stored properly in designated areas, e.g. chemical waste storage area?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.16	Is the designated chemical waste storage area used for storing chemical wastes only?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.17	Is chemical waste storage area suitable for the substance they are holding, resistant to corrosion, maintained in good condition?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.18	Is chemical waste storage area enclosed on at least 3 sides and securely closed?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.19	Is chemical waste storage area provided with bunds of a capacity to contain 110% of the total volume of container?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.20	Is chemical waste storage area well ventilated?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.21	Is chemical wastes storage area covered to prevent rainfall entering?(water collected within the bund must be tested and disposal as chemical waste if necessary)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.22	Is chemical waste storage area arranged so that incompatible materials are adequately separated?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.23	Are warning panels displayed at the waste storage area?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.24	Is the waste storage area cleaned and maintained regularly?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.25	Is chemical waste transported by a registered chemical waster collector to a facility licensed to receive chemical waste?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.26	Are all generators, fuel and oil storage located within bundle areas?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.27	Is oil leakage from machinery, vehicle and plant prevented?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.28	Are procedures as outlined in the Spillage Response Plan followed in the event of chemical waste/dangerous goods/ chemical spillage or leakage?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.29	Are the dangerous goods/chemical spillage or leakage procedures in place?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.30	Is approved personnel nominated? For example, site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.31	Is there any training of site personnel in proper waste management and chemical handling procedures provided?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.32	Is good site practices adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
4.33	Is there any recording system for the amount of wastes generated, recycled and disposed? For example, trip ticket system for chemical waste disposal. Quantities could be determined by weighting each load or other suitable methods.	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<b>Section 5: Landscape &amp; Visual</b>							
5.01	Is the maximum stockpiling height at the fill bank limited to a maximum of +35.2mPD?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.02	Is the landscape and visual mitigation measures in accordance with the landscape plan implemented during the operational and removal phases?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.03	Is the surface of outer slopes of the Fill Bank preferably hydroseeded or covered with geo-textile matting of appropriate colour (e.g dark green/brown) once completed?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.04	Is the design of the fill bank and plant form heights adopted allowed the fill bank to fit into the general topography of the surrounding land (straight edged slopes should be avoided)?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
5.05	Is the operation of barging point not allowed from 7:00 p.m. to 8:00 a.m. daily to avoid potential visual impact from glare?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

Not Obs.	Yes	No	Follow up	N/A	Photo/Remarks
----------	-----	----	-----------	-----	---------------

**Section 6: Others**

- 6.01 Is the fill bank site restricted access by the general public?
- 6.02 Is environmental permit displaced conspicuously on site?

<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

**Section 7: Follow-up for the Previous Environmental Inspection on date** 06.11.13 (Ref No. CEDPFRSFEM00\_131106\_TKOFB)

Is the situation in item <u>Fu①</u> improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<u>follow-up: p2</u>
Is the situation in item <u>Fu②</u> improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<u>follow-up: p4</u>
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is the situation in item _____ improved / rectified?	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	

**Remarks:**

- Follow-up:
- Fu① + Fu② is still pending for rectification.
- Observation:
- No new environmental observation is recorded.

Signature: CEDD's Representative	Signature: IEC Auditor	Signature: ET Auditor	Signature: Contractor's Representative
	<u>Jason</u>	<u>Mark</u>	
Name: <u>C. K. Woo</u>	Name: <u>K C LAH</u>	Name: <u>Mark Kei Wai</u>	Name: <u>S. W. S. S. S.</u>
Date: <u>25-11-2013</u>	Date: <u>25-NOV-13</u>	Date: <u>25/11/13</u>	Date: <u>125/11/2013</u>



Contract No.: CV/2009/02

Inspection Date: 25 November 2013

(1) Follow-up the previous inspection

Checklist No.: CEDPFRSFEM00\_131106\_TKOFB

Before



Photo 1

Silt Curtain

Silt curtain near the Tipping Hall No.1 is damaged.  
The Contractor is reminded to replace the damaged silt curtain as soon as possible.

After

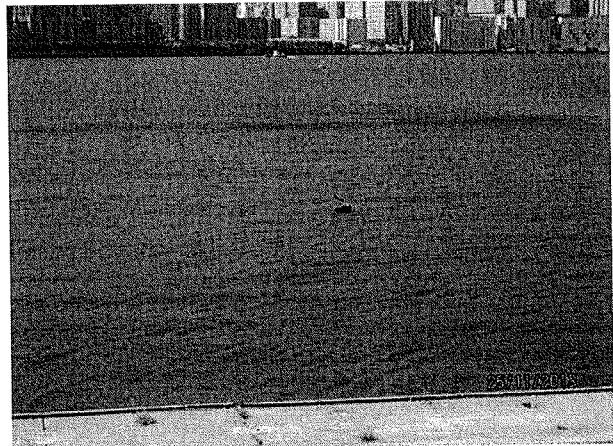


Photo 2

Silt Curtain

Silt curtain is still pending for rectification.

**(Follow-up)**

Before



Photo 3

Tipping Hall No.2

Cladding of tipping hall is damaged.  
The Contractor is reminded to repair the damaged part of tipping hall.

After

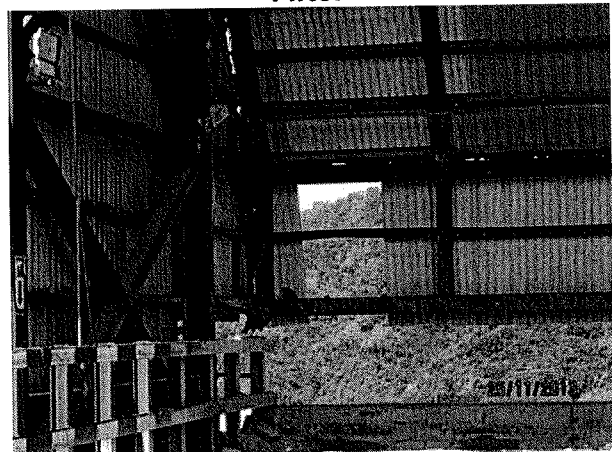


Photo 4

Tipping Hall No.2

Tipping hall is still pending for rectification.

**(Follow-up)**

(2) Observation during site inspection

Checklist No.: CEDPFRSFEM00\_131125\_TKOFB

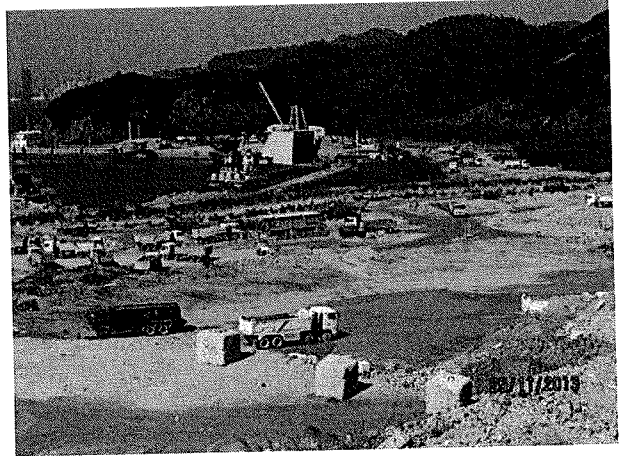
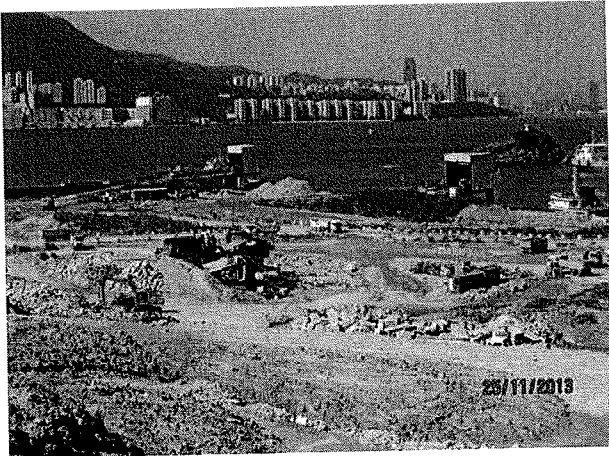


Photo 5 and 6

No new environmental observation is recorded.


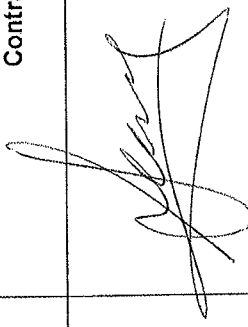

## Appendix I

### I

## Weekly ET's Site Inspection Record

CEDD Contract No.: CV/2009/02  
 Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

Inspection Date : 6/11/13  
 Time : 10:50  
 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy  
 Wind : Calm / Light / Breeze / Strong  
 Temperature : 26°C  
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	C. K. Wong	Kwok Siu Tung	Mak Sei Wai
Title	Accountant	CEO	Mark

Implementation Stages*		Remark
<b>Fugitive Dust Emission</b>		
✓		Dust control / mitigation measures shall be provided to prevent dust nuisance.
✓		A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.
✓		Water sprays shall be provided and used to dampen materials.
✓		Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.
✓		All vehicles shall be restrict to a maximum speed of 10 km per hour.
✓		Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.
✓		The designated site main haul road shall be paved or regular watering.
✓		Frequent watering of work site shall be at least three times per day.
✓		Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.
✓		Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.
✓		All plant and equipment should be well maintained e.g. without black smoke emission.
✓		Open burning should be prohibited.
✓		The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.
✓		Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.
✓		When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.
✓		The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.
✓		The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.
<b>Noise Impact</b>		
✓		The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.
✓		Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.
✓		Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.
✓		Air compressors and hand held breakers should have noise labels.
✓		Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.
✓		Noisy equipment and mobile plant shall always be site away from NSRs.

CEDD Contract No.: CV2009/02  
Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

### Environmental Checklist

	Implementation Stages*			Remark
	Yes	No	N/A	
<b>Water Quality</b>				
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓			
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	✓			
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓			
Manholes should be covered and sealed.	✓			
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓			
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓			
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	✓			
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓			
The temporary slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation water or protected by other method approved by CEDD.	✓			
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓			
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓			
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓			
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓			
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓			
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓			
Oil interceptor shall be provided at work shop.	✓			Item 2
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓			
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓			
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓			
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓			
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓			
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓			Item 1
A waste collection vessel shall be deployed to remove floating debris.	✓			

CEDD Contract No.: CV/2009/02  
 Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

Environmental Checklist		Implementation Stages*		Remark
		Yes	No / N/A	
<b>Landscape and Visual</b>				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	✓		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	✓		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	✓		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	✓		
<b>Other Environmental Factors</b>				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	✓		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	✓		
▪	All generators, fuel and oil storage are within bundle areas.	✓		
▪	Oil leakage from machinery, vehicle and plant is prevented.	✓		
▪	The Environmental Permit should be displaced conspicuously on site.	✓		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	✓		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓		


CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

**Summary of the Weekly Site Inspection:**

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 4 on 18/10/13, item 1 on 23/10/13 and item 1 on 30/10/13, the floating booms of silt curtain near the tipping hall No.1 was still found damaged.	To repair the damaged part of silt curtain as soon as possible.	131106_001	Yes	13/11/13
2	Follow up action to item 3 on 23/10/13 and item 1 on 30/10/13, the enclosure of tipping hall No. 2 was still found damaged.	To repair the damaged part of tipping hall as soon as possible.	131106_002	Yes	13/11/13

Remark

---

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		06 November 2013

Checked by



Photos

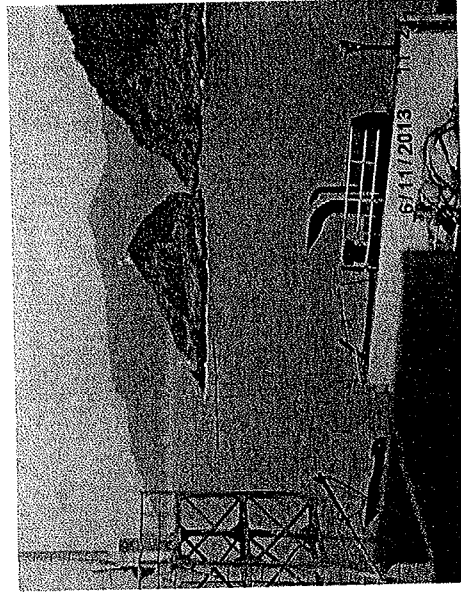


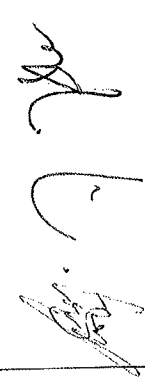
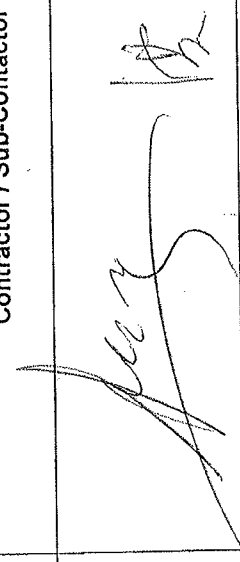
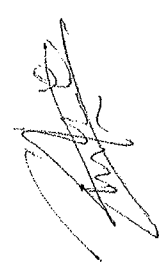
Photo 131106\_001 (Silt curtain near tipping hall No.1)



Photo 131106\_002 (Tipping hall No. 2)

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

Inspection Date : 13-11-2013  
 Time : 16:30  
 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy  
 Wind : Calm / Light / Breeze / Strong  
 Temperature : 24  
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	C. K. Yau F.O. 201 NCC/PS	S. Yuen Li Kam Hong	Tung Ching Hong
Title	Assistant I.O.S./PS	A.E.O S.S.	E.T

Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
<b>Fugitive Dust Emission</b>				
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.	✓			Item 2
▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	✓			
▪ Water sprays shall be provided and used to dampen materials.	✓			
▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	✓			
▪ All vehicles shall be restrict to a maximum speed of 10 km per hour.	✓			
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	✓			
▪ The designated site main haul road shall be paved or regular watering.	✓			
▪ Frequent watering of work site shall be at least three times per day.	✓			
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	✓			
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	✓			
▪ All plant and equipment should be well maintained e.g. without black smoke emission.	✓			
▪ Open burning should be prohibited.	✓			
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓			
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓			
▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	✓			
▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	✓			
▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	✓			
<b>Noise Impact</b>				
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	✓			
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	✓			
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	✓			
▪ Air compressors and hand held breakers should have noise labels.	✓			
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	✓			
▪ Noisy equipment and mobile plant shall always be site away from NSRs.	✓			

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

Environmental Checklist	Implementation Stages*		Remark
	Yes	No	
<b>Water Quality</b>			
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓		
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	✓		
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓		
Manholes should be covered and sealed.	✓		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓		
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓		
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	✓		
The stormwater intercepting system shall be effective to collect runoff and remove suspended solids before discharge.	✓		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓		
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓		
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓		
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓		
Oil interceptor shall be provided at work shop.	✓		Item 2
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓		
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓		
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓		
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓		Item 1
A waste collection vessel shall be deployed to remove floating debris.	✓		


Environmental Checklist		Implementation Stages*		Remark
		Yes	No	
<b>Landscape and Visual</b>				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√		
<b>Other Environmental Factors</b>				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√		
▪	All generators, fuel and oil storage are within bundle areas.	√		
▪	Oil leakage from machinery, vehicle and plant is prevented.	√		
▪	The Environmental Permit should be displaced conspicuously on site.	√		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√		

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwun O Fill Bank



**Summary of the Weekly Site Inspection:**

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 4 on 18/10/13, item 1 on 23/10/13, item 1 on 30/10/13 and item 1 on 06/11/13, the floating booms of silt curtain near the tipping hall No. 1 was still found damaged.	To repair the damaged part of silt curtain as soon as possible.	131113_001	Yes	20/11/13
2	Follow up action to item 3 on 23/10/13 and item 1 on 30/10/13 and item 2 on 06/11/13, the enclosure of tipping hall No. 2 was still found damaged.	To repair the damaged part of tipping hall as soon as possible.	131113_002	Yes	20/11/13

Remark  
---

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		13 November 2013

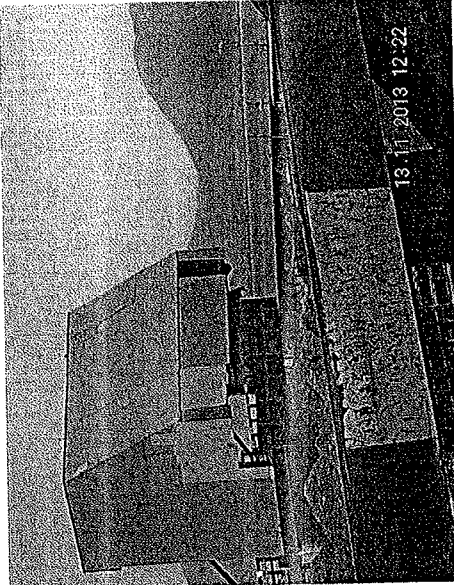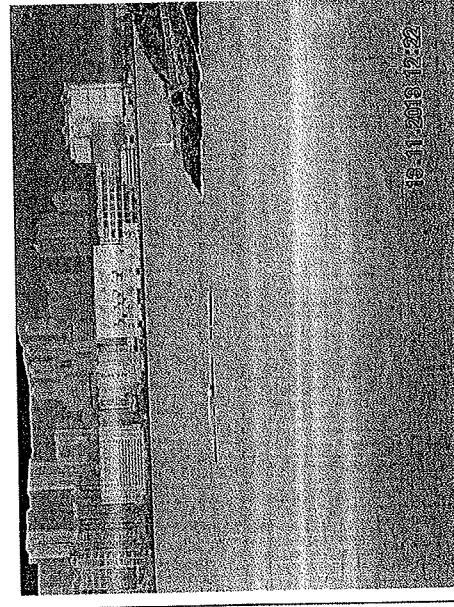

Photos

	 <p>Photo 131113_002 (Tipping hall No. 2)</p>	 <p>Photo 131113_001 (Silt curtain near tipping hall No.1)</p>
--	---	---



CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

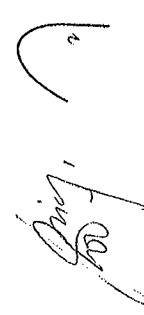Inspection Date : 20/11/13  
 Time : 10:30  
 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy  
 Wind : Calm / Light / Breeze / Strong  
 Temperature : 22°C  
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			Mark
Name:	C. K. Joo F.X.M. CSTA	S.W. Sun T. Likantung	Mark Sei Wai
Title	AO/CP	AO SS	E.T



Implementation Stages*		Remark
<b>Environmental Checklist</b>		
<b>Fugitive Dust Emission</b>		
✓		Dust control / mitigation measures shall be provided to prevent dust nuisance.
✓		A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.
✓		Water sprays shall be provided and used to dampen materials.
✓		Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.
✓		All vehicles shall be restricted to a maximum speed of 10 km per hour.
✓		Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.
✓		The designated site main haul road shall be paved or regular watering.
✓		Frequent watering of work site shall be at least three times per day.
✓		Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.
✓		Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.
✓		All plant and equipment should be well maintained e.g. without black smoke emission.
✓		Open burning should be prohibited.
✓		The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.
✓		Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.
✓		When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.
✓		The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.
✓		The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.
<b>Noise Impact</b>		
✓		The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.
✓		Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.
✓		Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.
✓		Air compressors and hand held breakers should have noise labels.
✓		Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.
✓		Noisy equipment and mobile plant shall always be site away from NSRs.
		Item 2

CEDD Contract No.: CV2009/02  
 Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

Environmental Checklist	Implementation Stages*		Remark
	Yes	No / N/A	
<b>Water Quality</b>			
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√		
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√		
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√		
Manholes should be covered and sealed.	√		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√		
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√		
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√		
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√		
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√		
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√		
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√		
Oil interceptor shall be provided at work shop.	√		Item 2
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√		
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√		
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√		
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√		Item 1
A waste collection vessel shall be deployed to remove floating debris.	√		

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

### Environmental Checklist

Implementation Stages*	Remark	
	Yes	No / N/A
<b>Landscape and Visual</b>		
<ul style="list-style-type: none"> <li>▪ The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> <li>▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +36.2mPD.</li> <li>▪ Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> <li>▪ The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	<ul style="list-style-type: none"> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> </ul>	
<b>Other Environmental Factors</b>		
<ul style="list-style-type: none"> <li>▪ C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> <li>▪ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.</li> <li>▪ Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> <li>▪ All generators, fuel and oil storage are within bundle areas.</li> <li>▪ Oil leakage from machinery, vehicle and plant is prevented.</li> <li>▪ The Environmental Permit should be displaced conspicuously on site.</li> <li>▪ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> <li>▪ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	<ul style="list-style-type: none"> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> </ul>	


CEDD Contract No.: CV/2009/02  
 Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

**Summary of the Weekly Site Inspection:**

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 4 on 18/10/13, item 1 on 23/10/13, item 1 on 30/10/13, item 1 on 06/11/13 and item 1 on 13/11/13, the floating booms of silt curtain near the tipping hall No.1 was still found damaged.	To repair the damaged part of silt curtain as soon as possible.	131120_001	Yes	27/11/13
2	Follow up action to item 3 on 23/10/13, item 1 on 30/10/13, item 2 on 06/11/13 and item 2 on 13/11/13, the enclosure of tipping hall No. 2 was still found damaged.	To repair the damaged part of tipping hall as soon as possible.	131120_002	Yes	27/11/13

Remark

---

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		20 November 2013

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

Photos

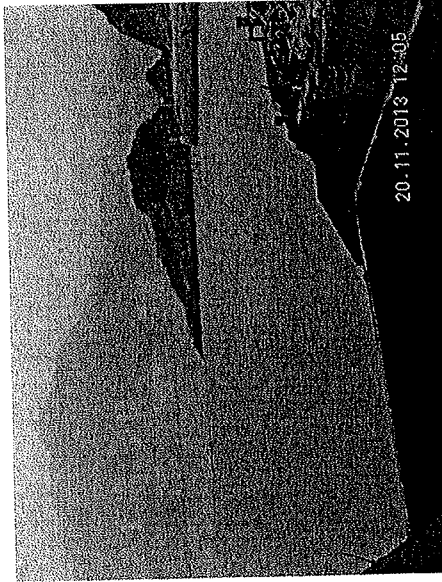


Photo 131120\_001 (Silt curtain near tipping hall No.1)

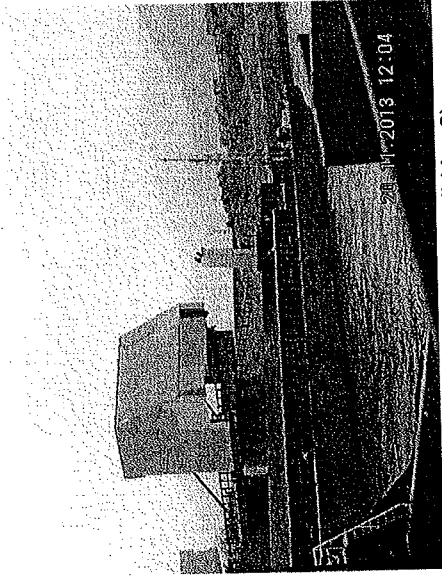



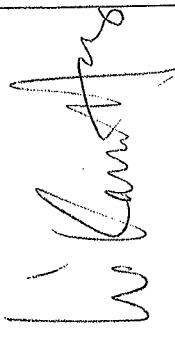



Photo 131120\_002 (Tipping hall No. 2)

CEDD Contract No.: CV/2009/02  
 Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

Inspection Date : 25/11/13  
 Time : 10:20  
 Weather : Sunny Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy  
 Wind : Calm / Light / Breeze / Strong  
 Temperature : 18°C  
 Humidity : High / Moderate Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature: 			
Name: C.K. Lo		S.W. Sun & 	
Title: Group		ATO	E.T

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
<b>Fugitive Dust Emission</b>				
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.	✓			Item 2
▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	✓			
▪ Water sprays shall be provided and used to dampen materials.	✓			
▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	✓			
▪ All vehicles shall be restrict to a maximum speed of 10 km per hour.	✓			
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	✓			
▪ The designated site main haul road shall be paved or regular watering.	✓			
▪ Frequent watering of work site shall be at least three times per day.	✓			
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	✓			
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	✓			
▪ All plant and equipment should be well maintained e.g. without black smoke emission.	✓			
▪ Open burning should be prohibited.	✓			
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓			
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓			
▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	✓			
▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	✓			
▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	✓			
<b>Noise Impact</b>				
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	✓			
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	✓			
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	✓			
▪ Air compressors and hand held breakers should have noise labels.	✓			
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	✓			
▪ Noisy equipment and mobile plant shall always be site away from NSRs.	✓			

CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

Environmental Checklist	Implementation Stages*		Remark
	Yes	No / N/A	
<b>Water Quality</b>			
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓		
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	✓		
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓		
Manholes should be covered and sealed.	✓		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓		
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓		
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	✓		
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓		
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓		
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓		
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓		
Oil interceptor shall be provided at work shop.	✓		Item 2
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓		
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓		
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓		
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓		Item 1
A waste collection vessel shall be deployed to remove floating debris.	✓		



CEDD Contract No.: CV/2009/02  
Handling of Surplus Public Fill - Tseung Kwun O Fill Bank

Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
<b>Landscape and Visual</b>				
<ul style="list-style-type: none"> <li>▪ The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> <li>▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.</li> <li>▪ Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> <li>▪ The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	√			
<b>Other Environmental Factors</b>				
<ul style="list-style-type: none"> <li>▪ C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> <li>▪ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.</li> <li>▪ Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> <li>▪ All generators, fuel and oil storage are within bundle areas.</li> <li>▪ Oil leakage from machinery, vehicle and plant is prevented.</li> <li>▪ The Environmental Permit should be displaced conspicuously on site.</li> <li>▪ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> <li>▪ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	√			


CEDD Contract No.: CV/2009/02  
 Handling of Surplus Public Fill - Tseung Kwan O Fill Bank

**Summary of the Weekly Site Inspection:**

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 4 on 18/10/13, item 1 on 23/10/13, item 1 on 30/10/13, item 1 on 06/11/13, item 1 on 13/11/13 and item 1 on 20/11/13, the floating booms of silt curtain near the tipping hall No.1 was still found damaged.	To repair the damaged part of silt curtain as soon as possible.	131125_001	Yes	04/12/13
2	Follow up action to item 3 on 23/10/13, item 1 on 30/10/13, item 2 on 06/11/13 and item 2 on 13/11/13 and item 2 on 20/11/13, the enclosure of tipping hall No. 2 was still found damaged.	To repair the damaged part of tipping hall as soon as possible.	131125_002	Yes	04/12/13

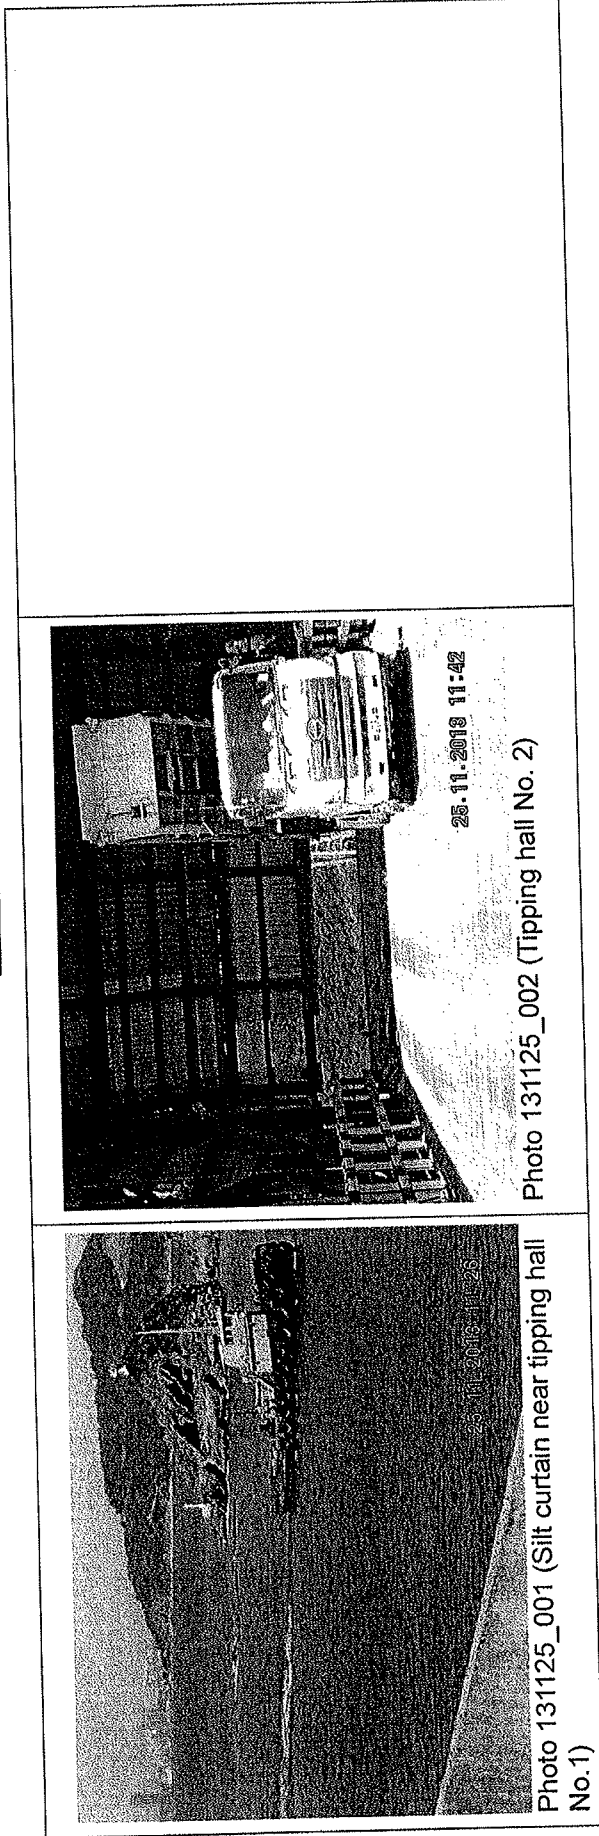
Remark

---

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		25 November 2013

Checked by

Photos





## Appendix I

### J

## Implementation Schedule of Mitigation Measures





Handling of Surplus Public Fill – Tseung Kwan O Area 137 Fill Bank  
Contract No.: CV/2009/02

	Location	Implementation Status		
		Implemented	Partially implemented	Not implemented
<b>Water Quality</b>				
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	All areas	✓		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	All areas	✓		
The existing / realigned intercepting channels and the sand / silt removal facilities shall be used and maintained regularly.	All areas	✓		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank.	Along the seafront		✓	
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	C&DMSF			✓
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	All areas	✓		
The material shall be properly covered to prevent washed away especially before rainstorm.	All areas	✓		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	Temporary Slopes	✓		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	Wheel Washing facility	✓		
Obtain Discharge License	Site Office	✓		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	Barge Handling Area (BHA)	✓		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	Barge Handling Area (BHA)	✓		
A waste collection vessel shall be deployed to remove floating debris.	Barge Handling Area (BHA)	✓		
<b>Landscape and Visual</b>				
Construction of lighting to avoid spillage and glare	All areas	✓		
Hydro-seeding	Completed slopes	✓		
Hoarding erection	Site boundary	✓		
Damage to surrounding area avoided	All areas	✓		
<b>Other Environmental Factors</b>				
C&D waste sorted from mixed C&D material shall be transfer to SENT landfill for disposal.	All areas	✓		
Plan and stock construction materials carefully to minimise generation of waste.	All areas	✓		
Any unused materials or those with remaining functional capacity should be recycled.	All areas	✓		
All generators, fuel and oil storage are within bunded areas.	All areas	✓		
Oil leakage from machinery, vehicle and plant is prevented.	All areas	✓		
Bund chemical storage area to 110% capacity.	All areas	✓		
Prevent disposal of hazardous materials to air, soil and water body.	All areas	✓		
Provide rubbish skips at all work areas	All areas	✓		
Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	All areas	✓		



## Appendix I

### K

## Site General Layout plan

- NOTES**
1. ALL DIMENSIONS UNLESS OTHERWISE SPECIFIED ARE IN METERS.
  2. ALL WORK IS TO BE COMPLETED WITHIN THE PERIOD SPECIFIED IN THE CONTRACT.
  3. ALL WORK IS TO BE COMPLETED WITHIN THE PERIOD SPECIFIED IN THE CONTRACT.
  4. ALL WORK IS TO BE COMPLETED WITHIN THE PERIOD SPECIFIED IN THE CONTRACT.
  5. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE APPROPRIATE AUTHORITIES.
  6. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE APPROPRIATE AUTHORITIES.
  7. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE APPROPRIATE AUTHORITIES.
  8. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE APPROPRIATE AUTHORITIES.
  9. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE APPROPRIATE AUTHORITIES.
  10. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE APPROPRIATE AUTHORITIES.

- LEGEND**
- SITE BOUNDARY
  - EXISTING BOUNDARY
  - EXISTING CONCRETE WALLS 150mm
  - EXISTING FINISH
  - EXISTING EXTERIOR LIGHT
  - EXISTING DOOR
  - EXISTING CONCRETE SLAB 100mm
  - EXISTING FINISH

NO.	DATE	DESCRIPTION	BY	CHKD.
1	20/11/2020	ISSUED FOR TENDER	...	...
2	20/11/2020	ISSUED FOR TENDER	...	...
3	20/11/2020	ISSUED FOR TENDER	...	...
4	20/11/2020	ISSUED FOR TENDER	...	...
5	20/11/2020	ISSUED FOR TENDER	...	...
6	20/11/2020	ISSUED FOR TENDER	...	...
7	20/11/2020	ISSUED FOR TENDER	...	...
8	20/11/2020	ISSUED FOR TENDER	...	...
9	20/11/2020	ISSUED FOR TENDER	...	...
10	20/11/2020	ISSUED FOR TENDER	...	...

PROJECT NO. ...  
 DRAWING NO. ...  
 SHEET NO. ...

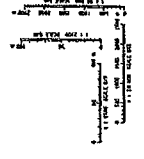
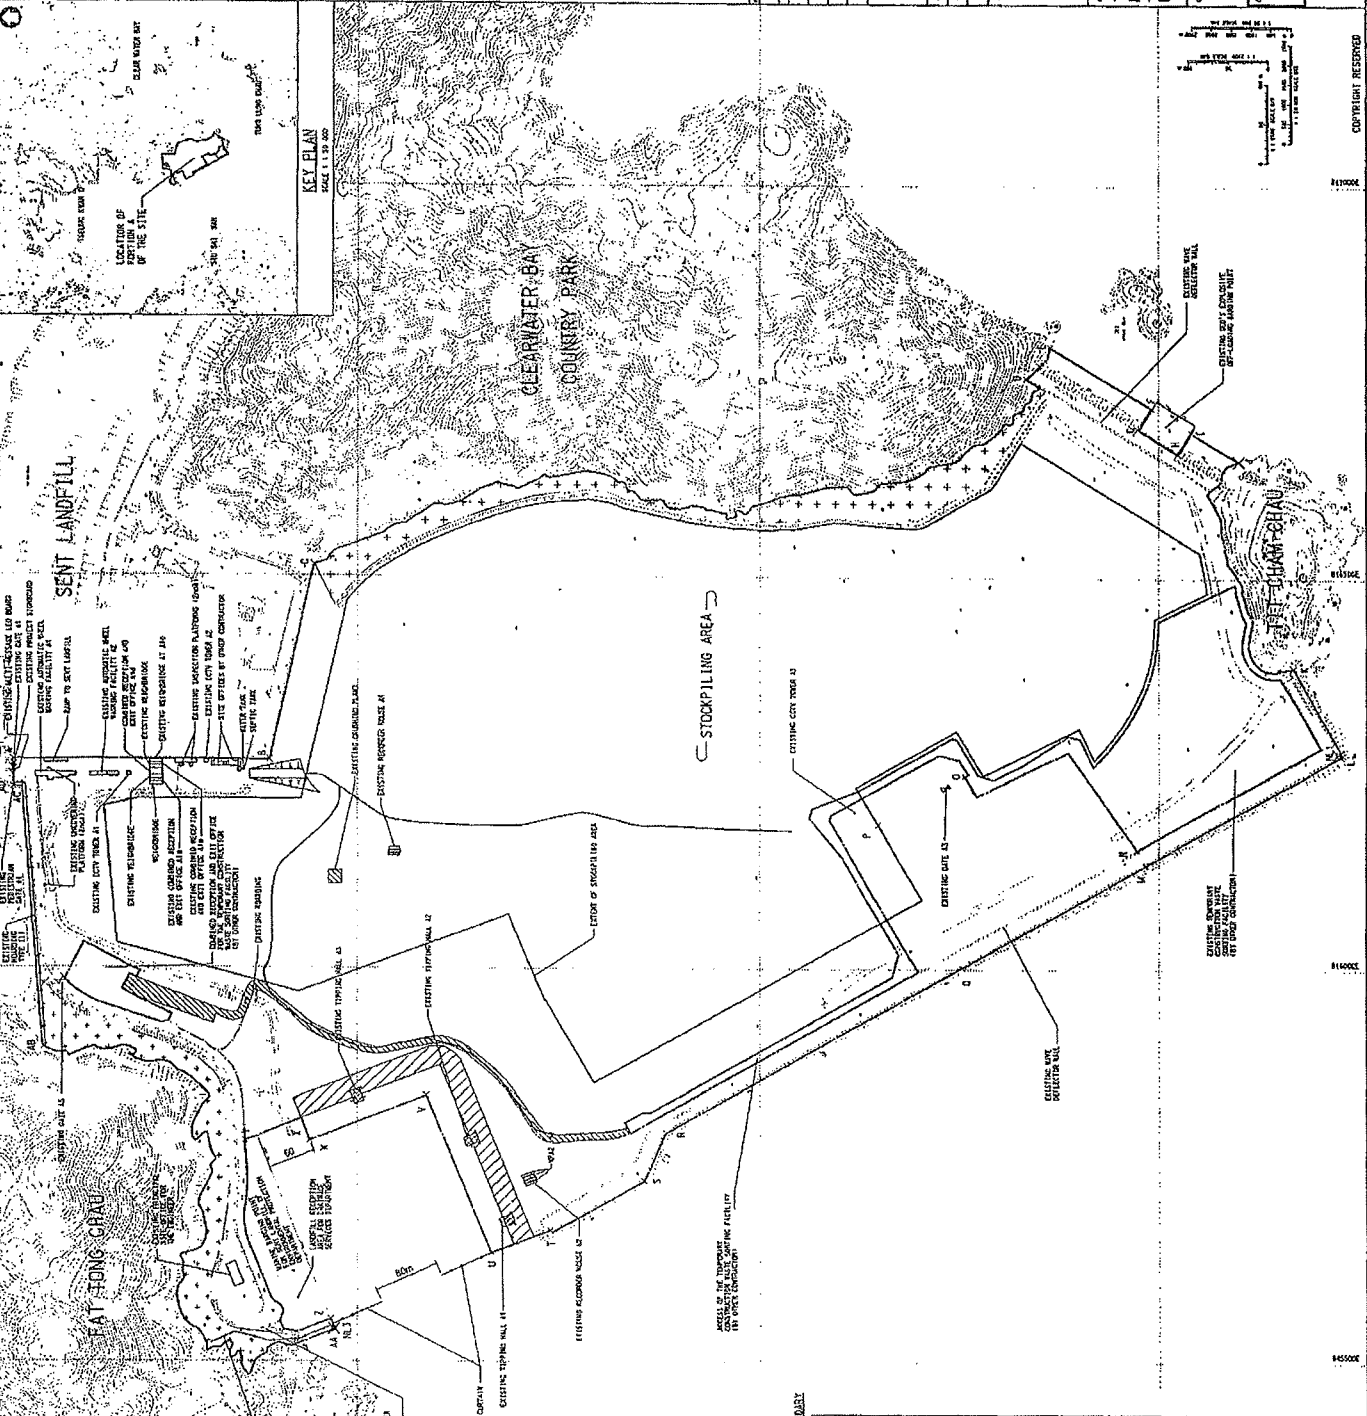
**HANDLING OF SURPLUS  
 PUBLIC FILL**

TRESSING NEAR D AREA 137  
 FILL BANK  
 GENERAL LAYOUT OF  
 EXISTING FACILITIES

SCALE: 1:250  
 DATE: ...

FILL MANAGEMENT DIVISION  
 CIVIL ENGINEERING OFFICE

CEDD  
 CIVIL ENGINEERING AND  
 SURVEYING DEPARTMENT



**SCISSOR-CUT DETAILS OF SITE BOUNDARY**

POINT	X COORDINATE	Y COORDINATE
1	118127.811	442822.122
2	118127.811	442822.122
3	118127.811	442822.122
4	118127.811	442822.122
5	118127.811	442822.122
6	118127.811	442822.122
7	118127.811	442822.122
8	118127.811	442822.122
9	118127.811	442822.122
10	118127.811	442822.122
11	118127.811	442822.122
12	118127.811	442822.122
13	118127.811	442822.122
14	118127.811	442822.122
15	118127.811	442822.122
16	118127.811	442822.122
17	118127.811	442822.122
18	118127.811	442822.122
19	118127.811	442822.122
20	118127.811	442822.122
21	118127.811	442822.122
22	118127.811	442822.122
23	118127.811	442822.122
24	118127.811	442822.122
25	118127.811	442822.122
26	118127.811	442822.122
27	118127.811	442822.122
28	118127.811	442822.122
29	118127.811	442822.122
30	118127.811	442822.122





## Appendix I

### L

## Monitoring Schedule for the Coming Month

## Contract No. CV/2009/02 Handling of Surplus Public Fill

### Tseung Kwan O Area137

**Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hr TSP & 24-hr TSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitoring (NM)**

**December 2013**

Sun	Mon	Tue	Wed	Thu	Fri	Sat
1 / 12	2 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (10:30 -12:30) Mid-flood (16:00 -18:00)	3	4 <u>1-hr TSP</u> <u>Weekly SI</u> <u>WQM</u> Mid-ebb (12:00 -14:00) Mid-flood (17:30 -19:30)	5 <u>24 hr TSP</u>	6 <u>1-hr TSP x 2</u> <u>WQM</u> Mid-flood (08:30-10:30) Mid-ebb (13:30-15:30)	7
8	9 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (11:00-12:00) Mid-ebb (17:00-19:00)	10	11 <u>1-hr &amp; 24 hr</u> <u>Weekly SI</u> <u>NM</u> <u>WQM</u> Mid-flood (13:00-15:00) Mid-ebb (18:45-20:45)	12	13 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (08:30 -10:30) Mid-flood (14:15 -16:15)	14
15	16 <u>1- hr TS P</u> <u>WQM</u> Mid-ebb (10:30 -12:30) Mid-flood (16:00 -18:00)	17 <u>24 hr TSP</u>	18 <u>1-hr TSP x 2</u> <u>Weekly SI</u> <u>WQM</u> Mid-ebb (11:45 -13:45) Mid-flood (17:00 -19:00)	19	20 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (13:00 -15:00) Mid-flood (17:30 -19:30)	21
22	23 <u>1-hr &amp; 24 hr</u> <u>Weekly SI</u> <u>WQM</u> Mid-flood (09:30-11:30) Mid-ebb (15:00-17:00)	24	25	26	27 <u>1-hr TSP x 2</u> <u>WQM</u> Mid-flood (12:30-14:30) Mid-ebb (18:45-20:45)	28
29 <u>24 hr TSP</u>	30 <u>1-hr TSP x 2</u> <u>Weekly SI</u> <u>WQM</u> Mid-ebb (09:30 -11:30) Mid-flood (14:45 -16:45)	31	1 / 1			



## **Appendix I**

### **M**

## **Complaint Log**

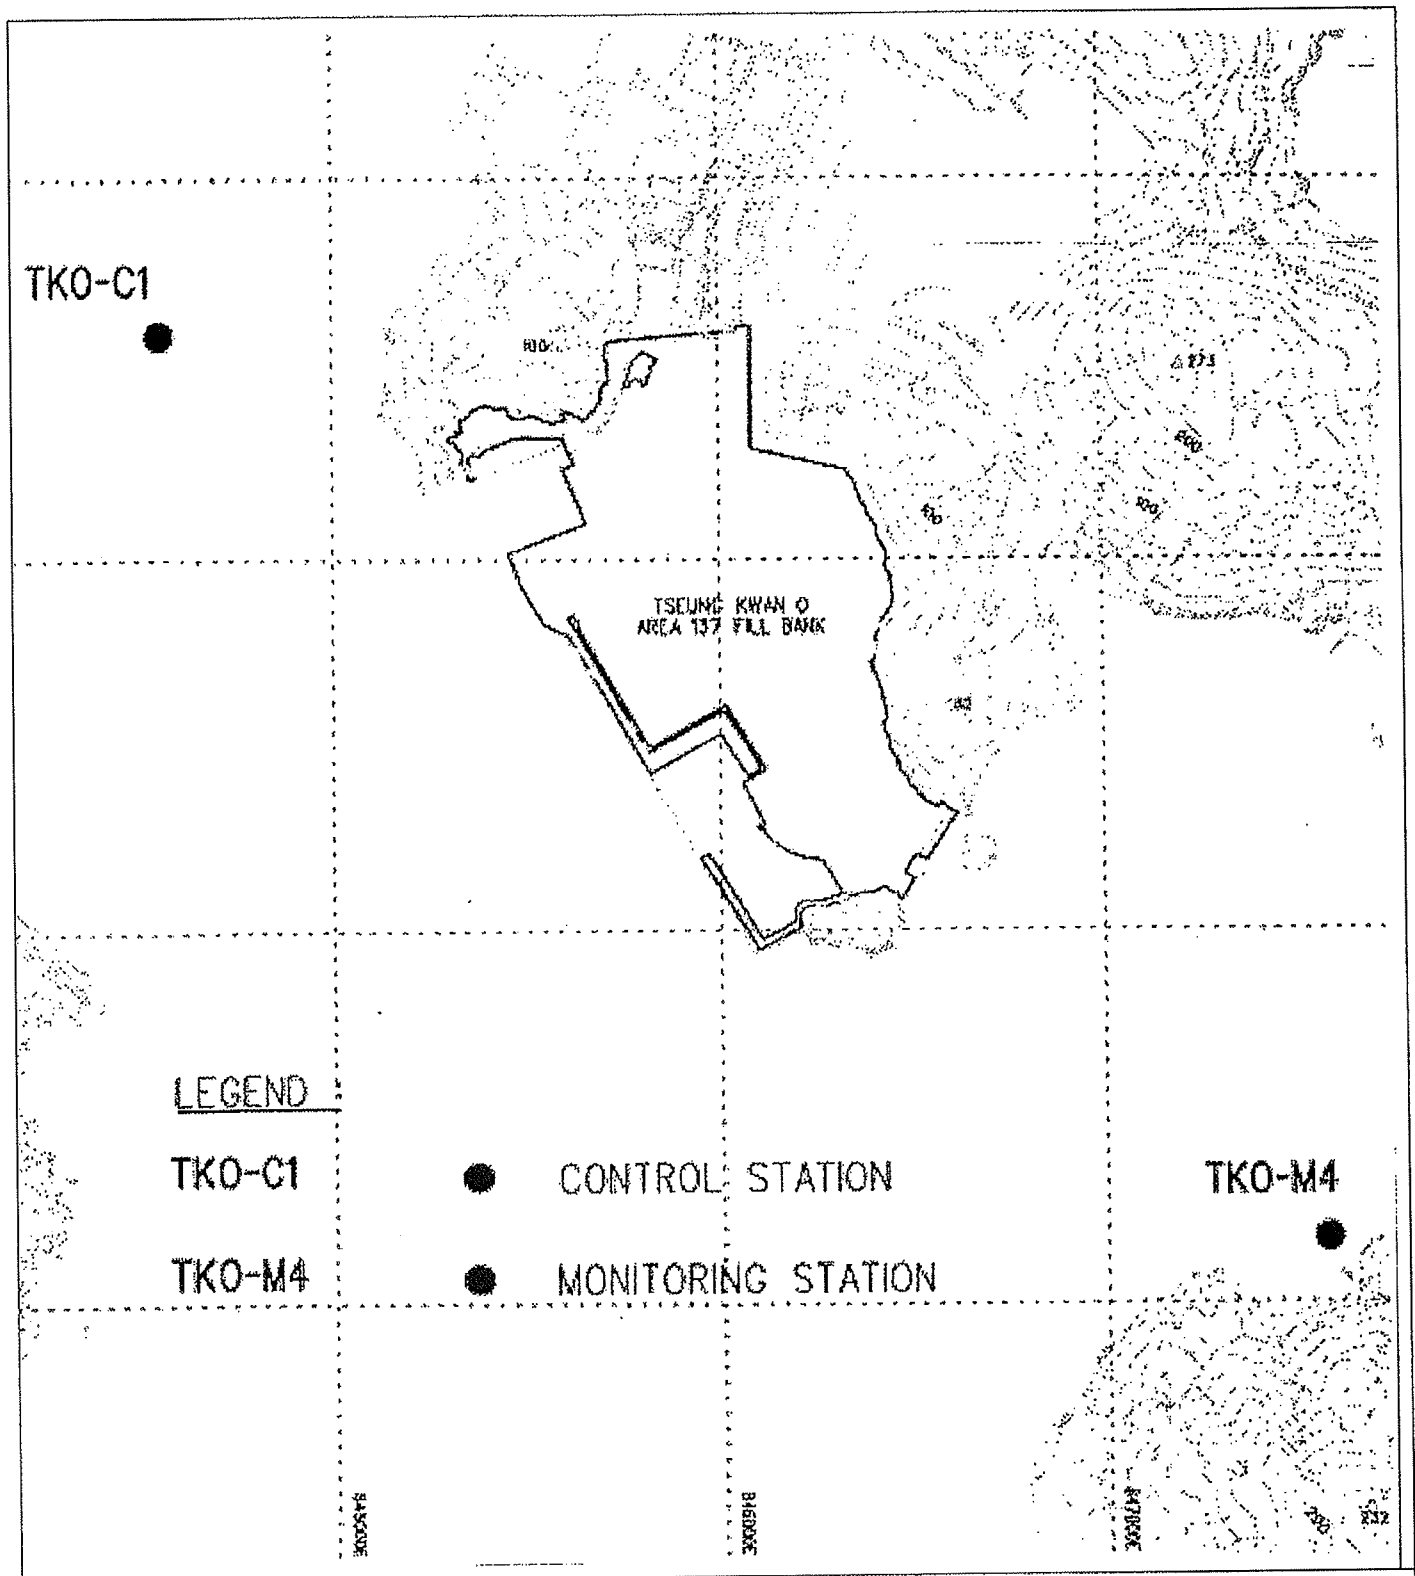
## Complaint Logs

Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
001	Working Area of the Fill Bank	25 August 2010	Three complaints received on 06 and 08 Aug 2010 was forwarded by the EPD on 25 August 2010 (Ref No.: (3) in EP3/N08/RE/00013438-10) from a citizen against dust emission at working area of the Fill Bank which caused by no water spray. The complainant complained that the dust generated caused an environmental nuisance.	<p>In response to the complaint, EPD had taken site investigations on 12 Aug 2010. During the site investigation, some improvements in the situation were noted by EPD and EPD reminded the Contractor to implement appropriate dust control measures as suggested in the EIA report to minimize dust impact to the environment, such as increasing the frequency of watering and spraying the site area especially during dry weather.</p> <p>Besides, a complaint Investigation report of this event have prepared by ET. From the investigation report, it noted that water spraying in the Fill Bank was not sufficient during the weekly site inspection on 07 Aug 2010 but there was no exceedance in air quality on 07 and 08 Aug 2010. Nevertheless, in view of our observation on site, the Contractor was still urged to increase the frequency of watering in the Project site especially during dry weather condition in order to enhance the air quality of the Project site. During the subsequently weekly site inspection on 14 Aug 2010, no more dust emission was observed in the Project site. It believed that the Contractor had provided as much as dust control measures to mitigate the problem and the air quality was further improved.</p>	Closed
002	Working Area of the Fill Bank	20 September 2011	Two complaints received on 24 and 29 August 2011 was forwarded by the EPD on 20 September 2011 (Ref No.: (2) in EP3/N08/RE/00017553-11) from public against dust emission at TKO137 Fill Bank. The complainant complained that the dust generated caused an environmental nuisance.	<p>Refer the EPD site investigation, no excessive emission of dust was revealed from the TKO137 Fill Bank. However, the Contractor was reminded to take more effort on the dust depression measures in the site area.</p> <p>Besides, a complaint Investigation report of this event have prepared by ET. From the investigation report, it noted that no fugitive dust emission was observed at TKO137 Fill Bank during the weekly site inspection on 24 and 31 August 2011 and no air quality exceedance was recorded during the dust monitoring period from 24 to 31 August 2011. Generally, the Contractor has implemented dust control measures to reduce dust impact to the environment but some improvement should be carried out. The Contractor should take more effort on the frequency of watering on site especially during dry weather.</p>	Closed




## Appendix I

### Figures



Contract No. CV/2009/02  
 Handling of Surplus Public Fill

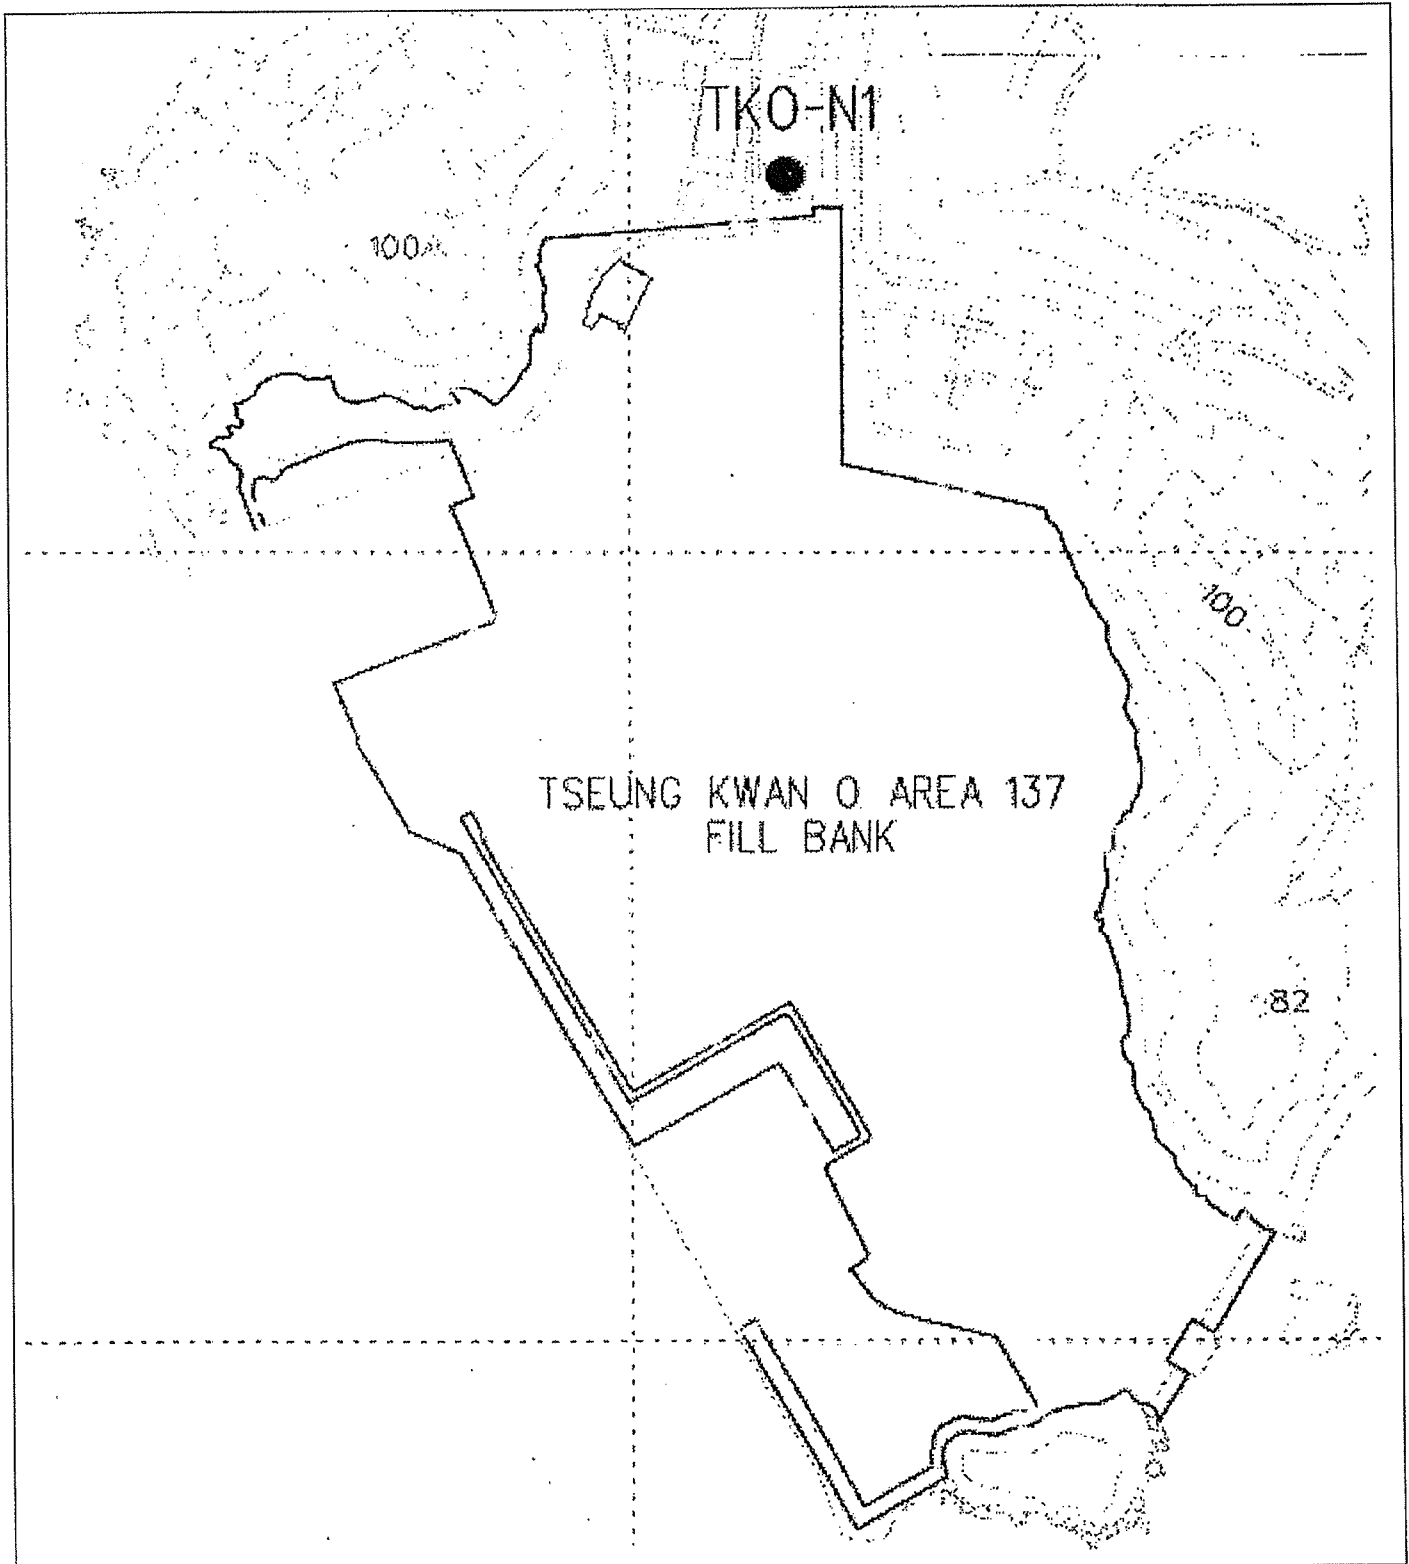Figure 1  
 Locations of Water Quality Monitoring Stations –  
 Tseung Kwan O Area 137 Fill Bank



Contract No. CV/2009/02  
Handling of Surplus Public Fill

Figure 2  
Locations of Noise Monitoring Station –  
Tseung Kwan O Area 137 Fill Bank




東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED

Contract No.  
CV/2009/02  
Handling of  
Surplus Public  
Fill

Title:  
Locations of Air  
Quality  
Monitoring  
Stations -  
Tseung Kwan O  
Area 137 Fill  
Bank

ETS-Testconsult  
Ltd

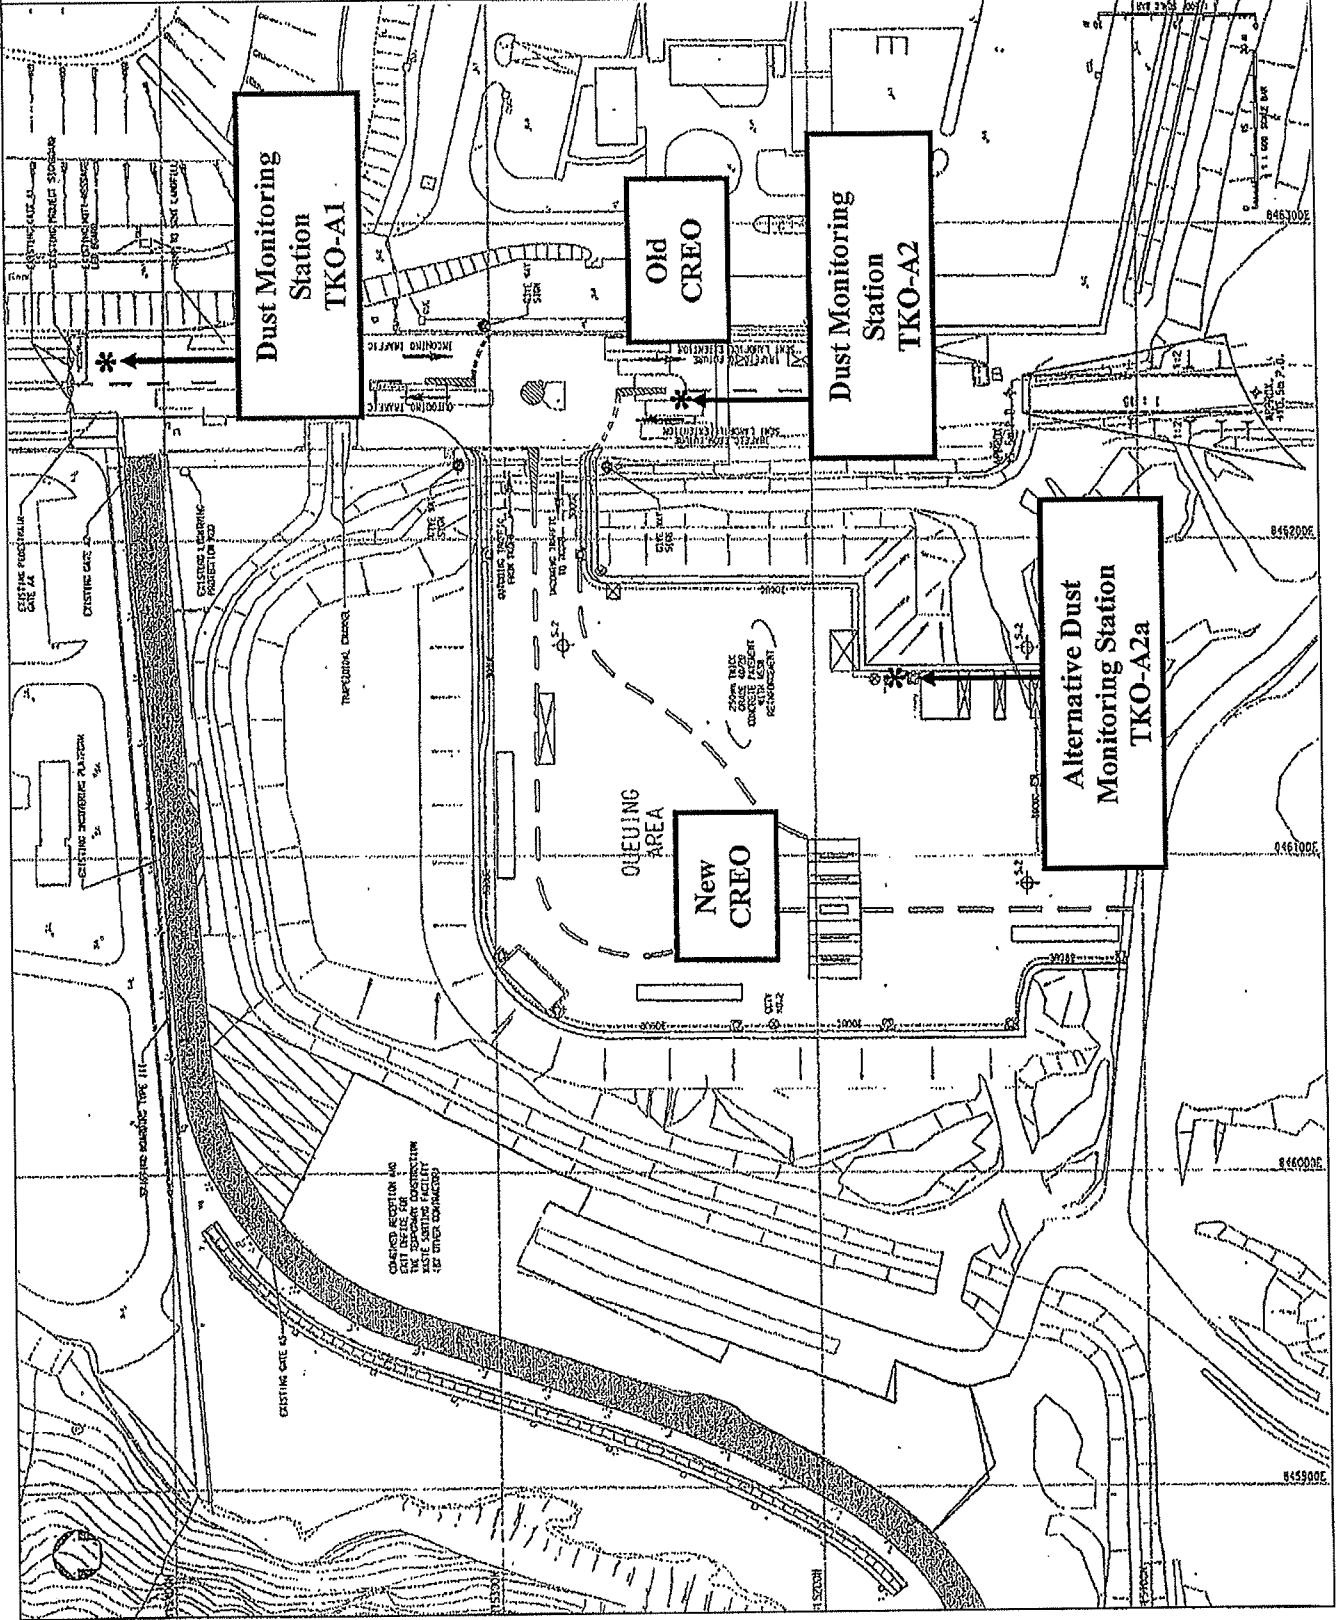Figure 3a







## Appendix II



**Marine Water Quality Monitoring Report for Contract No. HY/2010/02  
Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing  
Facilities – Reclamation Works**

**China Harbour Engineering Company Limited**

Contract No. HY/2010/02

**Hong Kong – Zhuhai – Macao Bridge  
Hong Kong Boundary Crossing  
Facilities –  
Reclamation Works****Impact Water Quality Monitoring Report  
for TKO 137 Fill Bank  
November 2013**

[12/2013]

	Name	Signature
Prepared & Checked:	Isabella Yeung	
Reviewed & Approved:	Y T Tang	

Version:	Rev. 0	Date: 13 December 2013
<b>Disclaimer</b> <p>This report is prepared for China Harbour Engineering Company Limited and is given for its sole benefit in relation to and pursuant to Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities-Reclamation Works and may not be disclosed to, quoted to or relied upon by any person other than China Harbour Engineering Company Limited without our prior written consent. No person (other than China Harbour Engineering Company Limited) into whose possession a copy of this report comes may rely on this report without our express written consent and China Harbour Engineering Company Limited may not rely on it for any purpose other than as described above.</p>		

<p>AECOM Asia Co. Ltd. 15/F, Grand Central Plaza, Tower 1, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com</p>
---

**TABLE OF CONTENTS**

	Page
EXECUTIVE SUMMARY .....	I
1 INTRODUCTION .....	1
1.1 Background.....	1
1.2 Purpose of the Report.....	1
1.3 Structure of the Report .....	1
2 WATER QUALITY .....	2
2.1 Monitoring Requirements.....	2
2.2 Monitoring Equipment.....	2
2.3 Monitoring Parameters, Frequency and Duration.....	2
2.4 Monitoring Locations.....	2
2.5 Monitoring Methodology .....	3
2.6 Action and Limit Levels.....	4
3 MONITORING RESULTS .....	5
4 CONCLUSIONS .....	7

**List of Tables**

Table 2.1	Water Quality Monitoring Equipment.....	2
Table 2.2	Water Quality Monitoring Parameters, Frequency and Duration .....	2
Table 2.3	Location of Water Quality Impact Stations .....	3
Table 2.4	Action and Limit Levels for Water Quality .....	4
Table 2.5	Summary of Marine Water Monitoring Results for Mid-ebb Tide .....	5
Table 2.6	Summary of Marine Water Monitoring Results for Mid-flood Tide .....	5
Table 2.7	Summary of Marine Water Monitoring Exceedance.....	6

**List of Figures**

Figure 1.1	Site Layout Plan for TKO 137 Fill Bank
Figure 2.1	Impact Water Quality Monitoring Stations at TKO 137 Fill Bank

**List of Appendices**

Appendix A	Calibration Records
Appendix B	Impact Monitoring Schedules
Appendix C	Impact Water Quality Monitoring Results and their Graphical Presentation
Appendix D	QA/QC Report

## EXECUTIVE SUMMARY

On-site sorting facilities for imported material (public fill) for reclamation works of the “Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below known as “the Works Area). Impact monitoring of water quality was conducted at the designated monitoring location. This report presents the impact monitoring results regarding water quality aspects performed in November 2013.

### *Water Quality*

Impact water quality monitoring was conducted at three monitoring stations, C1a, M4a & M5. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations. The impact monitoring was carried out three times per week (from 1 to 30 November 2013) during the operation of the mentioned facilities for both mid-ebb and mid-flood tides. Data of temperature, salinity, dissolved oxygen (DO), turbidity (Tby) and suspended solids (SS) were collected and analysed. Details of the monitoring methodology, locations and results are presented in this report.

### **Breaches of Action and Limit Levels for Water Quality**

No exceedance of Action and Limit Level of water quality monitoring results was recorded in the reporting month.

## **1 INTRODUCTION**

### **1.1 Background**

- 1.1.1 Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) mainly comprises reclamation at the northeast of the Hong Kong International Airport of an area of about 130-hectare for the construction of an artificial island for the development of the Hong Kong Boundary Crossing Facilities (HKBCF), and about 19-hectare for the southern landfall of the Tuen Mun - Chek Lap Kok Link (TMCLKL).
- 1.1.2 On-site sorting facilities for imported material (public fill) for reclamation works of the Project were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below, known as “the Works Area”). The proposed sorting facilities together with barging points, tipping halls and associated facilities will be installed at the Works Area.
- 1.1.3 The latest Environmental Permit (EP) for Fill Bank at TKO Area 137 was issued on 4 February 2013 (EP-134/2002/K) by the Environmental Protection Department (EPD) to Civil Engineering and Development Department (CEDD), the Permit Holder, regarding the Project. Condition 3.2 of the EP requires the water quality monitoring frequency and parameters at stations C1a, M4a and M5 shall be same as the requirements set out in the EM&A Manual for TKO 137 Fill Bank (here below, known as “EM&A Manual”) and the monitoring results shall be incorporated in the monthly EM&A reports.

### **1.2 Purpose of the Report**

- 1.2.1 The purpose of this impact monitoring report is to assess environmental impact and compliance during transportation and operation of the mentioned facilities for the Project. This report presents the impact monitoring requirements, methodologies and results of water quality measurements in accordance with the EM&A Manual.
- 1.2.2 This impact report presents the monitoring works of water quality monitoring, at two monitoring stations (M4a and M5) and one control station (C1a), conducted in November 2013. A layout plan of the Works Area is provided in Figure 1.1.

### **1.3 Structure of the Report**

- 1.3.1 The structure of the report is as follows:

Section 1: Introduction, background, purpose and the structure of the report.

Section 2: Water quality, which describes the impact water quality monitoring requirements, methodology and action/limit level.

Section 3: Impact water quality monitoring results.

Section 4: Conclusions.

## 2 WATER QUALITY

### 2.1 Monitoring Requirements

2.1.1 Impact marine water quality monitoring at 3 water quality monitoring stations should be established. In accordance with the EM&A Manual, impact water quality monitoring should be conducted 3 days per week during the operation of the facilities in the Works Area. Moreover, as stipulated in the latest EP, water quality monitoring should be conducted since 2 weeks before commencement of operation of the additional barging points. Measurements shall be taken at the 3 designated stations, 2 impact and 1 control stations at mid-flood and mid-ebb tides at three water depths, i.e., 1 m below surface, mid-depth and 1 m from seabed.

### 2.2 Monitoring Equipment

2.2.1 Equipment used in the impact water quality monitoring programme is summarized in Table 2.1. A copy of the calibration certificates for the water quality monitoring equipment are attached in Appendix A.

**Table 2.1 Water Quality Monitoring Equipment**

Parameter	Model and Make
Coordinate of Monitoring stations	Garmin etrex 10
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI Pro2030
Turbidity	HACH Model 2100Q Turbid Meter
Water Depth	Speedtech Instrument SM-5A

### 2.3 Monitoring Parameters, Frequency and Duration

2.3.1 Table 2.2 summarises the monitoring parameters, frequency and duration of impact water quality monitoring. Impact water quality monitoring was carried out at three stations in November 2013. Detailed impact water quality monitoring schedule was provided in Appendix B.

**Table 2.2 Water Quality Monitoring Parameters, Frequency and Duration**

Monitoring Stations	Parameter, unit	Frequency	No. of Depths
Control Stations: C1a  Impact Stations: M4a – M5	<ul style="list-style-type: none"> <li>• Depth, m</li> <li>• Temperature, °C</li> <li>• Salinity, ppt</li> <li>• DO, mg/L</li> <li>• DO Saturation, %</li> <li>• Turbidity, NTU</li> <li>• Suspended Solids (SS), mg/L</li> </ul>	Three times per week during mid-ebb and mid-flood tides (within ± 1.75 hour of the predicted time)	3 (1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth is less than 6 m, in which case the mid-depth station may be omitted. Should the water depth be less than 3 m, only the mid-depth station will be monitored).

### 2.4 Monitoring Locations

2.4.1 The measurements were taken at all designated impact and control stations summarized in Table 2.3. The two impact stations were chosen on the basis of their proximity to the Works Area, which would be under the greatest potential for water quality impacts. In addition, a control station was also set up for ebb-tide references respectively of the surrounding ambient.

**Table 2.3 Location of Water Quality Impact Stations**

Station I.D.	HK 1980 Grid		Status
	Easting	Northing	
C1a	845647	814146	Control Station (Ebb-tide)
M4a	845922	813973	Impact Station (Close to Additional Barging Point, Tipping Halls and Associated Facilities at TKO 137 Fill Bank)
M5	847005	813678	Impact Station (Close to Tai Miu Wan)

## 2.5 Monitoring Methodology

### 2.5.1 Instrumentation

- (a) The in-situ water quality parameters, viz. dissolved oxygen, temperature, salinity and turbidity were measured by multi-parameter meters and turbidity was measured by Turbid Meter.

### 2.5.2 Operating/Analytical Procedures

- (a) A hand-held digital Global Positioning Systems (GPS) were used to ensure that the correct location was selected prior to sample collection.
- (b) Portable, battery-operated echo sounders were used for the determination of water depth at each designated monitoring station.
- (c) All in-situ measurements were taken at 3 water depths, 1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth was less than 6 m, in which case the mid-depth station was omitted. Should the water depth be less than 3 m, only the mid-depth station was monitored.
- (d) At each measurement/sampling depth, two consecutive in-situ monitoring (DO concentration and saturation, temperature, turbidity, salinity) and water sample for SS were collected. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO concentration and saturation, temperature and salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. Where the difference in the value between the first and second readings of DO or turbidity parameters was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- (e) Duplicate samples from each independent sampling event were collected for SS measurement. Water samples were collected using the water samplers and the samples were stored in high-density polythene bottles. Water samples collected were well-mixed in the water sampler prior to pre-rinsing and transferring to sample bottles. Sample bottles were pre-rinsed with the same water samples. The sample bottles were then be packed in cool-boxes (cooled at 4°C without being frozen), and delivered to Environmental Laboratory, ETS-Testconsult Ltd. (HOKLAS Registration No. 022) for the analysis of suspended solids concentrations. The laboratory determination work would be started within 24 hours after collection of the water samples. Environmental Laboratory, ETS-Testconsult Ltd., is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes. For QA/QC procedures, one duplicate samples of every batch of 20 samples was analyzed and attached in Appendix D.

### 2.5.3 Maintenance and Calibration

- (a) Before each round of monitoring, the dissolved oxygen probe of YSI Pro2030 was calibrated by the wet bulb method.
- (b) The monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS before use and subsequently re-calibrated at 3-monthly intervals throughout all stages of the water quality monitoring.



**2.6 Action and Limit Levels**

2.6.1 The Action and Limit Levels (AL levels) have been set in accordance with the derivation criteria specified in the EM&A Manual. This is shown in Table 2.4.

**Table 2.4 Action and Limit Levels for Water Quality**

Parameters	Action	Limit
DO in mg/L (Surface & Middle, Bottom)	Surface & Middle 5.5 mg/L  Bottom 5.2 mg/L	Surface & Middle 4.0 mg/L  Bottom 2.0 mg/L
SS in mg/L (depth-averaged)	4.9 mg/L or 120% of upstream control station's SS at the same tide of the same day	5.2 mg/L or 130% of upstream control station's SS at the same tide of the same day and specific sensitive receiver water quality requirements (e.g. required suspended solids level at FCZ)
Turbidity in NTU (depth-averaged)	3.9 NTU or 120% of upstream control station's turbidity at the same tide of the same day	4.2 NTU or 130% of upstream control station's turbidity at the same tide of the same day

- Notes:
- "depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
  - For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
  - For turbidity, SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.
  - All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.

### 3 MONITORING RESULTS

3.1.1 The impact water quality monitoring results for C1a, M4a and M5 are summarized in Tables 2.5 and 2.6. Detail water quality monitoring results are presented in Appendix C.

**Table 2.5 Summary of Marine Water Monitoring Results for Mid-ebb Tide**

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	24.8 (22.8 - 25.9)	25.6 (24.6 - 28.5)	6.0 (5.5 - 6.6)	5.7 (5.5 - 6.1)	81.7 (75.4 - 91.5)	3.4 (3 - 3.9)	4.4 (3.8 - 5)
M4a	24.8 (22.8 - 25.9)	25.6 (24.5 - 28.5)	5.9 (5.6 - 6.6)	5.8 (5.6 - 6.5)	81.4 (76.7 - 91.6)	3.3 (3 - 3.8)	4.4 (3.8 - 5)
M5	24.7 (22.7 - 25.9)	25.6 (24.6 - 28.5)	5.9 (5.6 - 6.5)	5.8 (5.5 - 6.2)	81.5 (75.4 - 91)	3.4 (3 - 4)	4.4 (3.8 - 5.2)

**Table 2.6 Summary of Marine Water Monitoring Results for Mid-flood Tide**

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	24.8 (22.7 - 27.6)	25.6 (24.5 - 28.6)	6.0 (5.6 - 6.6)	5.8 (5.6 - 6.2)	82.6 (76.1 - 92.9)	3.3 (2.9 - 4.1)	4.4 (3.6 - 5.2)
M4a	24.8 (22.7 - 27.8)	25.6 (24.6 - 28.4)	6.0 (5.6 - 6.5)	5.9 (5.8 - 6.5)	82.4 (77.5 - 91.5)	3.3 (3 - 3.9)	4.4 (3.8 - 5)
M5	24.8 (22.7 - 25.9)	25.6 (24.6 - 28.4)	6.0 (5.7 - 6.7)	5.8 (5.6 - 6.3)	82.4 (76.1 - 93.2)	3.4 (3 - 3.9)	4.4 (3.8 - 5.2)

- 3.1.2 The weather conditions during the monitoring period were generally cloudy and fine. Sea conditions for the majority of monitoring days were generally calm and small wave. No major water pollution source, which might affect the result observed during the impact monitoring period.
- 3.1.3 Since the water depths at all the monitoring stations were generally higher than 6m, sampling was conducted at three water depths at each station.

3.1.4 The summary of impact water quality exceedance is shown in Table 2.7.

**Table 2.7 Summary of Marine Water Monitoring Exceedance**

Monitoring Station	Exceedance Level	DO (SM)		DO(Bottom)		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
M4a	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0
M5	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0

Note: S: Surface; and  
 M: Mid-depth.

3.1.5 No exceedance of Action and Limit Level of water quality monitoring results was recorded in the reporting month.

## **4 CONCLUSIONS**

- 4.1.1 This impact monitoring report presents impact monitoring results for water quality at designated locations C1a, M4a and M5 in accordance with the EM&A Manual. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations.
- 4.1.2 All laboratory results satisfied the QA/QC requirements and all monitoring equipment is properly calibrated and with valid calibration certificates.
- 4.1.3 No exceedance of Action and Limit Level of water quality monitoring results was recorded in the reporting month.

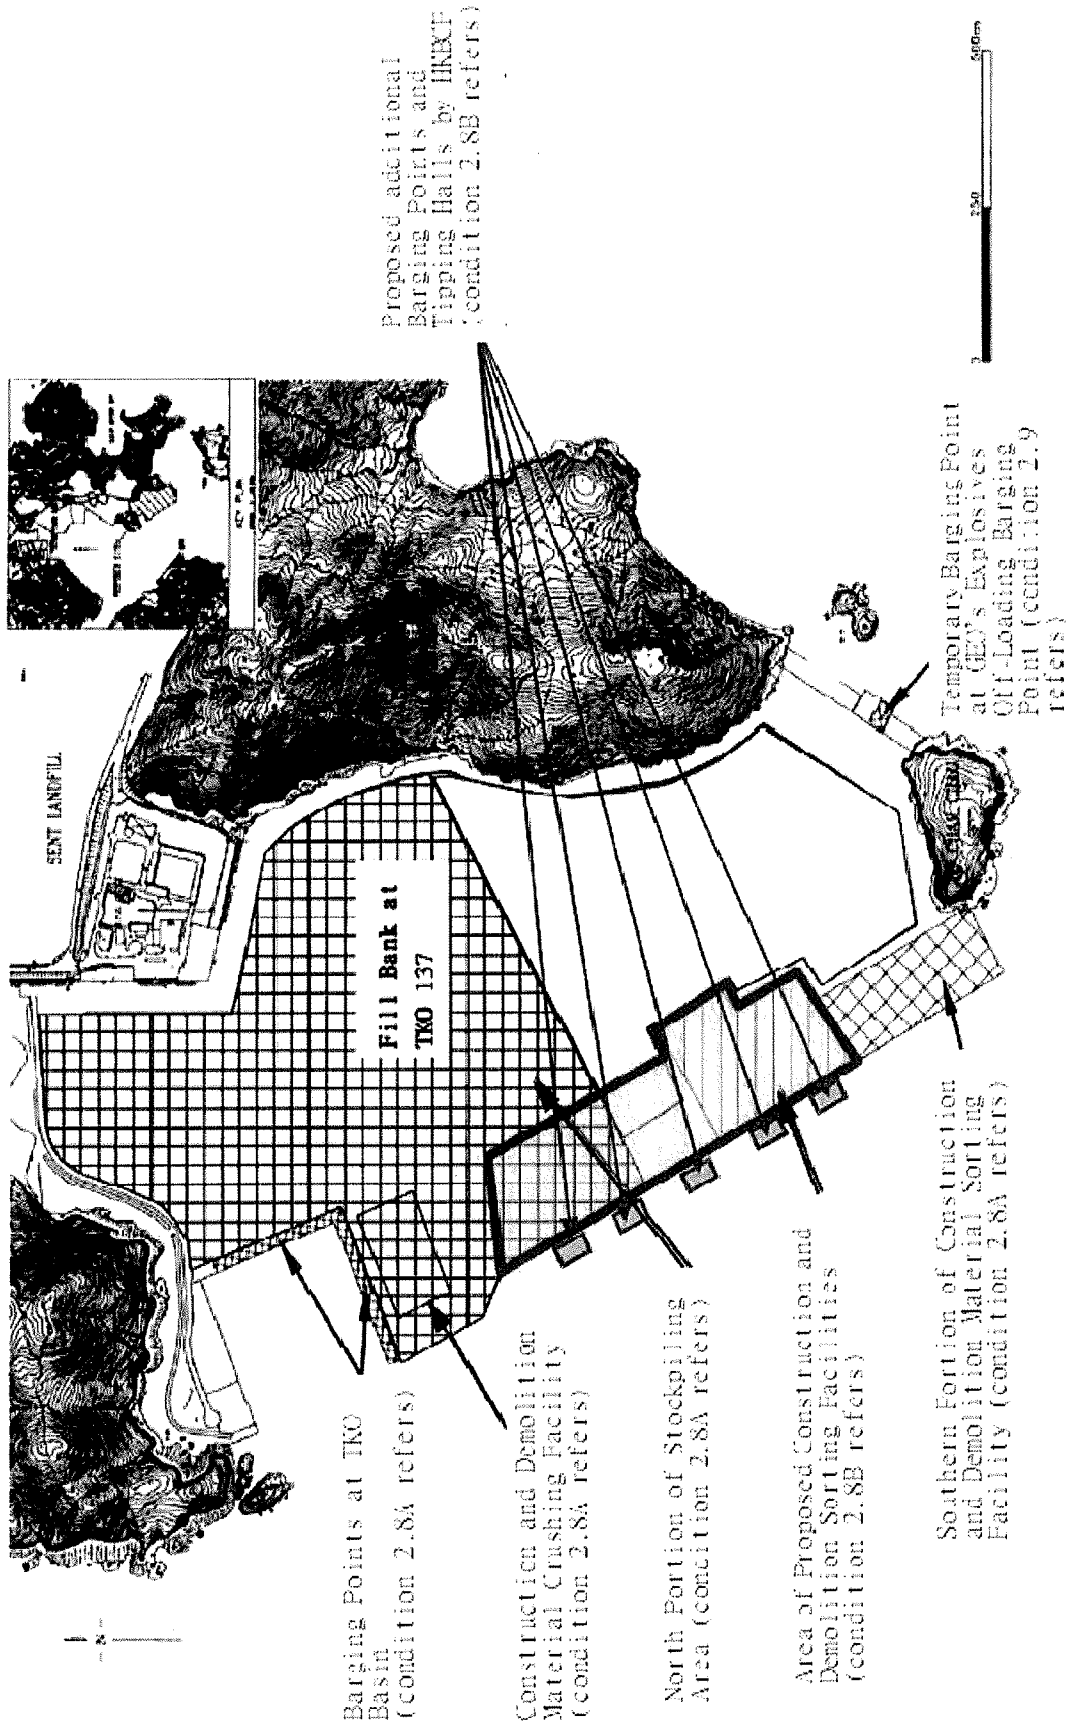
---

---

## FIGURES

---

---




(Plan Originated from Figure 2 of Environmental Permit No.: EP-134/2002/K)

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent. All measurements must be obtained from the stated dimensions.

**HONG KONG - ZHUHAI - MACAO BRIDGE  
HONG KONG BOUNDARY CROSSING FACILITIES  
RECLAMATION WORKS**

**Site Layout Plan for TKO 137 Fill Bank**



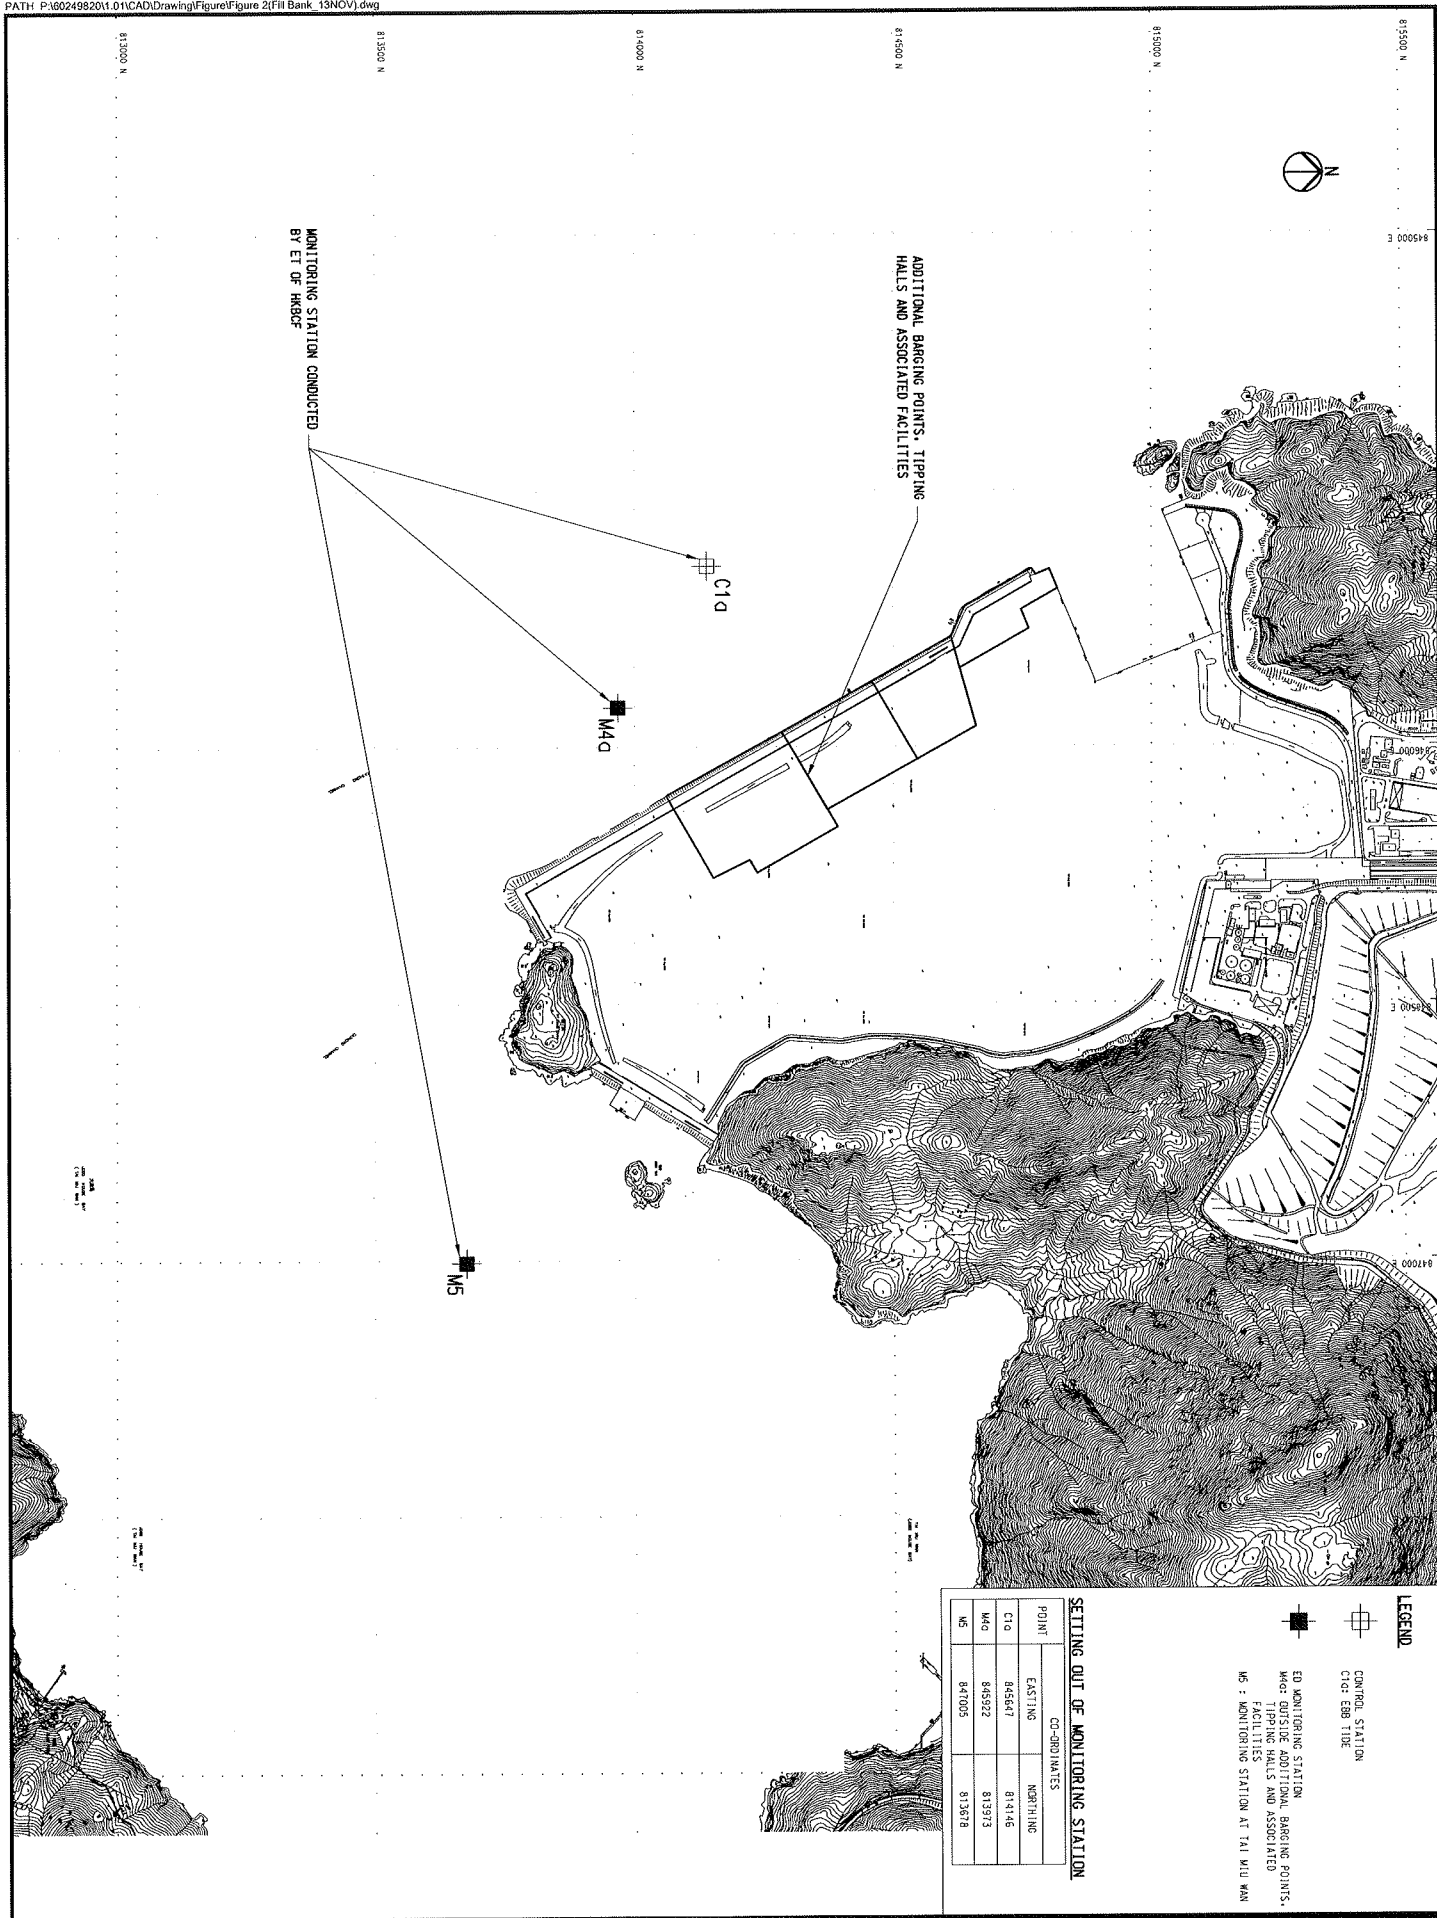

**APPENDIX A  
CALIBRATION RECORDS**





### Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/005</u>	Manufacturer : <u>YSI</u>
Model No. : <u>Pro 2030</u>	Serial No. : <u>12A 100353</u>
Date of Calibration : <u>29/10/2013</u>	Calibration Due Date : <u>28/01/2014</u>

**Temperature Verification**

Ref. No. of Reference Thermometer : ET/0521/008  
 Ref. No. of Water Bath : ---

		Temperature (°C)		
Reference Thermometer reading	Measured	20.3	Corrected	19.9
DO Meter reading	Measured	19.8	Difference	0.1

**Standardization of sodium thiosulphate (Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>) solution**

Reagent No. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> titrant	CPE/012/4.5/001/7	Reagent No. of 0.025N K <sub>2</sub> Cr <sub>2</sub> O <sub>7</sub>	CPE/012/4.4/001/22
		Trial 1	Trial 2
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		1.00	12.00
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		11.55	22.50
Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)		10.55	10.50
Normality of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02370	0.02381
Average Normality (N) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02376	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>, N = 0.25 / ml Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub> used

**Linearity Checking**

**Determination of dissolved oxygen content by Winkler Titration \***

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	11.80	23.40	0.00	8.00	13.00
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	11.80	23.40	31.50	8.00	13.00	18.10
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	11.80	11.60	8.10	8.00	5.00	5.10
Dissolved Oxygen (DO), mg/L	7.53	7.40	5.17	5.10	3.19	3.25
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.66	7.41	7.54	7.53	7.40	7.47	0.93
5	5.31	5.23	5.27	5.17	5.10	5.14	2.50
10	3.20	3.10	3.15	3.19	3.25	3.22	2.20
Linear regression coefficient				0.9987			



### Internal Calibration Report of Dissolved Oxygen Meter

**Zero Point Checking**

DO meter reading, mg/L	0.00
------------------------	------

**Salinity Checking**

Reagent No. of NaCl (10ppt)	CPE/012/4.7/002/11	Reagent No. of NaCl (30ppt)	CPE/012/4.8/002/11
-----------------------------	--------------------	-----------------------------	--------------------

**Determination of dissolved oxygen content by Winkler Titration \*\***

Salinity (ppt)	10		30	
	1	2	1	2
Trial				
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	12.40	24.50	35.80
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	12.40	24.50	35.80	47.00
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	12.40	12.10	11.30	11.20
Dissolved Oxygen (DO), mg/L	7.91	7.72	7.21	7.14
Acceptance criteria. Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation:  $DO (mg/L) = V \times N \times 8000/298$

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.82	7.63	7.73	7.91	7.72	7.82	1.16
30	7.22	7.16	7.19	7.21	7.14	7.18	0.14

**Acceptance Criteria**

- (1) Difference between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within + 5%

The equipment complies # / does not comply # with the specified requirements and is deemed acceptable # / unacceptable # for use.

# Delete as appropriate

Calibrated by :

Approved by :



## Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/005      Manufacturer : YSI  
Model No. : Pro 2030      Serial No. : 12A 100353  
Date of Calibration : <sup>28/10/2013</sup> ~~29/08/2013~~ <sub>28/01/2014</sub>      Due Date : 28/01/2014

Ref. No. of Salinity Standard used (30ppt)


S/001/4


Salinity Standard (ppt)	Measured Salinity (ppt)	Difference %
30.0	30.8	2.63

Acceptance Criteria

Difference : <10 %

The salinity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 



## Performance Check of Turbidity Meter



Equipment Ref. No. : ET/0505/009                      Manufacturer : HACH  
Model No. : 2100Q                                      Serial No. : 11060 C 010010  
Date of Calibration : 08/10/2013                      Due Date : 07/01/2014

Gelex Vial Std	Theoretical Value (NTU)	Measured Value (NTU)	Difference %
0-10 NTU	5	5.2	3.92
10-100 NTU	50	5.19	3.73
100-1000 NTU	550	561	1.98

### Acceptance Criteria

Difference : -5 % to 5%

The turbidity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Checked by :                       Approved by : 

**APPENDIX B**  
**IMPACT MONITORING SCHEDULES**

**Contract No. HY/2010/02 - Hong Kong-Zhuhai-Macao Bridge  
 Hong Kong Boundary Crossing Facilities – Reclamation Works  
 Impact Water Quality Monitoring Schedule for November 2013 (TKO 137 Fill Bank)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					01-Nov Impact Water Quality Monitoring Mid-ebb: 10:33 Mid-flood: 16:33	02-Nov
03-Nov	04-Nov	05-Nov	06-Nov	07-Nov	08-Nov	09-Nov
	Impact Water Quality Monitoring Mid-ebb: 12:40 Mid-flood: 18:14		Impact Water Quality Monitoring Mid-flood: 08:32 Mid-ebb: 14:06		Impact Water Quality Monitoring Mid-flood: 10:26 Mid-ebb: 15:51	
10-Nov	11-Nov	12-Nov	13-Nov	14-Nov	15-Nov	16-Nov
	Impact Water Quality Monitoring Mid-flood: 13:44 Mid-ebb: 19:38		Impact Water Quality Monitoring Mid-ebb: 08:44 Mid-flood: 16:21		Impact Water Quality Monitoring Mid-ebb: 10:32 Mid-flood: 16:34	
17-Nov	18-Nov	19-Nov	20-Nov	21-Nov	22-Nov	23-Nov
	Impact Water Quality Monitoring Mid-ebb: 12:33 Mid-flood: 18:04		Impact Water Quality Monitoring Mid-flood: 08:23 Mid-ebb: 13:35		Impact Water Quality Monitoring Mid-flood: 09:48 Mid-ebb: 14:43	
24-Nov	25-Nov	26-Nov	27-Nov	28-Nov	29-Nov	30-Nov
	Impact Water Quality Monitoring Mid-flood: 12:38 Mid-ebb: 17:48		Impact Water Quality Monitoring Mid-flood: 14:00 Mid-ebb: 20:18		Impact Water Quality Monitoring Mid-ebb: 09:00 Mid-flood: 15:08	

**APPENDIX C  
IMPACT WATER QUALITY MONITORING  
RESULTS AND THEIR GRAPHICAL  
PRESENTATION**

**Mid-Ebb Tide**

**Monitoring Station : C1a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
01/11/13	0954-1012	26/Fine	Small Wave	20.4	Surface	25.5	26.5	26.6	5.7	80.1	80.3	3.0	3.0	4.2	4.1	4.2		
						25.4	26.6	5.7	79.4	5.7	3.0	4.0	4.0					
						25.3	26.7	5.7	79.0	3.2	3.1	4.4	4.4					
					Bottom	25.3	26.7	5.5	77.5	77.6	3.2	3.2	4.4	4.2				
						25.3	26.8	5.6	77.7	3.4	3.2	4.0	4.0					
						25.8	24.6	5.9	84.1	84.3	3.4	3.4	4.2	4.1				
04/11/13	1152-1210	22/Cloudy	Small Wave	19.4	Surface	25.8	24.6	24.6	6.0	84.5	84.3	3.5	3.4	4.0	4.1	4.1		
						25.9	24.7	5.5	78.3	78.2	3.3	3.3	4.4	4.3				
						25.8	24.7	5.5	78.0	3.3	3.3	4.2	4.2					
					Middle	25.8	24.7	5.7	80.6	80.9	3.0	3.1	3.8	3.9				
						25.8	24.8	5.7	81.1	3.1	3.1	4.0	4.0					
						25.9	24.6	5.9	84.3	84.2	3.4	3.4	4.2	4.3				
06/11/13	1325-1345	26/Cloudy	Small Wave	19.5	Surface	25.9	24.7	24.7	5.9	84.0	84.7	3.4	3.3	4.4	4.3	4.2		
						25.9	24.7	5.7	81.3	81.2	3.2	3.2	4.4	4.3				
						25.8	24.7	5.7	81.0	3.3	3.3	4.2	4.2					
					Bottom	25.7	24.9	5.8	82.3	82.2	3.1	3.1	4.0	3.9				
						25.6	24.8	5.8	82.0	3.2	3.2	3.8	3.8					
						25.7	24.6	6.0	84.5	84.7	3.3	3.3	4.2	4.3				
08/11/13	1525-1545	26/Cloudy	Small Wave	19.8	Surface	25.7	24.7	24.8	6.0	84.9	84.7	3.3	3.3	4.4	4.3	4.1		
						25.7	24.7	5.6	79.4	79.6	3.2	3.1	4.0	4.1				
						25.6	24.8	5.6	79.8	3.1	3.1	4.2	4.2					
					Bottom	25.6	24.9	5.7	80.4	80.6	3.0	3.0	4.0	3.9				
						25.5	24.9	5.7	80.8	3.0	3.0	3.8	3.8					
						25.5	25.2	6.1	84.9	84.4	3.2	3.3	4.2	4.3				
11/11/13	1824-1843	25/Cloudy	Small Wave	19.2	Surface	25.6	25.2	25.2	6.0	83.9	84.4	3.3	3.3	4.4	4.3	4.6		
						25.4	25.3	5.8	81.5	81.2	3.4	3.4	4.8	4.7				
						25.5	25.4	5.8	80.9	3.4	3.4	4.6	4.6					
					Bottom	25.4	25.5	5.6	78.4	78.8	3.6	3.6	4.6	4.7				
						25.3	25.5	5.7	79.1	3.6	3.6	4.8	4.8					
						25.4	25.3	6.0	83.6	83.2	3.1	3.2	4.2	4.3				
13/11/13	0820-0840	25/Cloudy	Small Wave	18.8	Surface	25.4	25.3	25.4	5.9	82.7	84.2	3.1	3.1	4.2	4.3	4.4		
						25.5	25.4	5.8	80.2	79.9	3.3	3.3	4.4	4.5				
						25.3	25.5	5.7	79.6	3.4	3.4	4.6	4.6					
					Bottom	25.3	25.6	5.5	77.1	77.5	3.5	3.5	4.4	4.5				
						25.2	25.7	5.6	77.8	3.5	3.5	4.6	4.6					
						25.5	25.3	6.0	84.4	84.2	3.1	3.1	4.2	4.3				
15/11/13	0955-1014	25/Fine	Small Wave	18.8	Surface	25.6	25.4	25.4	6.0	84.0	84.2	3.1	3.1	4.4	4.3	4.4		
						25.5	25.4	5.9	82.9	83.1	3.3	3.3	4.4	4.5				
						25.5	25.4	6.0	83.3	3.3	3.3	4.6	4.6					
					Bottom	25.4	25.5	5.5	77.5	77.7	3.4	3.4	4.4	4.5				
						25.3	25.4	5.6	77.8	3.4	3.4	4.6	4.6					
						25.5	25.1	6.0	84.1	84.0	3.1	3.2	4.2	4.1				
18/11/13	1155-1214	25/Fine	Small Wave	18.9	Surface	25.6	25.2	25.2	6.0	83.8	84.0	3.2	3.2	4.0	4.1	4.4		
						25.4	25.3	5.8	81.8	81.9	3.3	3.3	4.4	4.5				
						25.4	25.4	5.9	82.0	3.4	3.4	4.6	4.6					
					Bottom	25.3	25.4	5.6	78.1	78.0	3.4	3.4	4.6	4.7				
						25.3	25.4	5.5	77.8	3.4	3.4	4.8	4.8					
						25.4	25.5	5.5	77.8	3.5	3.5	4.8	4.8					



**Mid-Ebb Tide**

**Monitoring Station : C1a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	1255-1314	22/Cloudy	Small Wave	18.8	Surface	23.5	25.2	6.1	81.7	3.1	4.0	3.0	4.0	3.0	4.0		
						23.4	25.2	6.2	81.9	3.0	4.0						
						23.5	25.3	6.0	80.4	3.2	4.4						
						23.6	25.2	6.1	80.7	3.2	4.0						
						23.6	25.4	5.7	75.4	3.3	4.4						
						23.5	25.5	5.7	75.8	3.3	4.3						
22/11/13	1354-1415	22/Cloudy	Calm	19.6	Surface	22.8	28.4	6.5	91.0	3.5	4.2	3.5	4.3	3.5	4.3		
						22.8	28.4	6.6	91.5	3.6	4.4						
						22.8	28.4	6.4	90.2	3.5	4.8						
						22.8	28.4	6.4	89.9	3.4	4.8						
						22.8	28.4	6.3	88.4	3.6	4.6						
						22.8	28.5	6.3	87.8	3.7	4.8						
25/11/13	1720-1739	20/Fine	Small Wave	19.0	Surface	23.3	25.4	6.2	82.6	3.6	4.4	3.6	4.6	3.6	4.6		
						23.2	25.5	6.2	82.2	3.7	4.8						
						23.2	25.6	6.1	81.1	3.8	4.8						
						23.2	25.6	6.1	80.6	3.9	5.0						
						23.1	25.6	6.0	80.0	3.5	4.6						
						23.1	25.6	6.0	79.9	3.6	4.8						
27/11/13	1924-1939	21/Cloudy	Small Wave	18.8	Surface	23.1	25.5	6.3	83.0	3.6	4.4	3.6	4.6	3.6	4.6		
						23.1	25.4	6.2	82.6	3.6	4.8						
						23.2	25.6	6.1	81.6	3.8	4.8						
						23.1	25.6	6.1	81.1	3.8	4.8						
						23.4	25.6	6.1	80.4	3.5	4.4						
						23.4	25.7	6.1	80.3	3.6	4.6						
29/11/13	0821-0838	Cloudy	Small Wave	19.0	Surface	21.5	25.0	6.2	81.6	3.7	4.6	3.7	4.7	3.7	4.7		
						21.6	25.0	6.3	82.4	3.7	4.8						
						21.7	25.2	6.1	79.8	3.3	4.4						
						21.8	25.3	6.1	79.5	3.3	4.2						
						21.9	25.4	6.0	78.7	3.6	4.6						
						21.8	25.4	6.0	78.6	3.6	4.8						

# Mid-Flood Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)					
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average			
01/11/13	1554-1612	26/Fine	Small Wave	20.6	Surface	1.0	25.5	26.6	26.6	5.8	81.0	2.9	3.6	3.7	25.6	26.5	26.5	5.8	81.2	2.9	3.8
							25.5	26.6	26.6	5.8	81.1	2.9	3.7								
					Middle	10.3	25.4	26.7	26.7	5.7	80.3	3.0	4.2	3.0	25.4	26.7	26.7	5.7	80.1	3.1	4.0
							25.3	26.8	26.8	5.6	78.5	3.1	4.4								
					Bottom	19.6	25.3	26.8	26.8	5.6	78.6	3.1	4.2	3.1	25.3	26.8	26.8	5.6	78.6	3.1	4.3
							25.9	24.6	24.6	6.0	85.4	3.2	4.4								
04/11/13	1720-1735	22/Cloudy	Small Wave	19.6	Surface	1.0	25.9	24.6	24.6	6.0	85.7	3.2	4.4	4.4	25.8	24.8	24.8	5.8	80.6	3.3	4.2
							25.9	24.8	24.8	5.7	79.7	3.3	4.6								
					Middle	9.8	25.7	24.9	24.9	5.7	81.1	3.5	4.6	3.3	25.7	24.9	24.9	5.7	81.1	3.5	4.6
							25.7	24.9	24.9	5.7	81.8	3.4	4.4								
					Bottom	18.6	25.7	24.9	24.9	5.7	81.8	3.4	4.4	3.4	25.7	24.9	24.9	5.7	81.5	3.4	4.5
							25.9	24.6	24.6	6.0	85.2	3.3	4.4								
06/11/13	0825-0845	26/Cloudy	Small Wave	19.7	Surface	1.0	25.8	24.6	24.6	6.1	86.2	3.3	4.2	4.3	25.8	24.6	24.6	6.0	85.5	3.3	4.2
							25.8	24.7	24.7	5.6	79.9	3.2	4.0								
					Middle	9.9	25.8	24.6	24.6	5.7	80.4	3.2	4.2	3.2	25.8	24.6	24.6	5.7	80.2	3.2	4.1
							25.6	24.7	24.7	5.7	81.1	3.0	3.8								
					Bottom	18.7	25.6	24.7	24.7	5.7	81.1	3.0	3.8	3.0	25.6	24.7	24.7	5.7	81.2	3.0	3.9
							25.8	24.6	24.6	6.1	86.1	3.2	4.4								
08/11/13	0955-1015	26/Cloudy	Small Wave	20.2	Surface	1.0	25.7	24.5	24.5	6.1	86.2	3.3	4.4	4.4	25.7	24.5	24.5	6.1	86.1	3.2	4.4
							25.7	24.6	24.6	5.7	80.6	3.1	4.0								
					Middle	10.1	25.6	24.7	24.7	5.7	81.1	3.1	3.8	3.1	25.6	24.7	24.7	5.7	80.9	3.1	3.9
							25.5	24.8	24.8	5.8	81.7	3.0	3.6								
					Bottom	19.2	25.5	24.8	24.8	5.8	81.7	3.0	3.6	3.0	25.5	24.8	24.8	5.8	81.9	2.9	3.7
							25.8	24.6	24.6	6.1	86.1	3.2	4.4								
11/11/13	1250-1310	25/Cloudy	Calm	19.8	Surface	1.0	25.6	25.1	25.2	6.1	84.7	3.1	4.0	4.1	25.6	25.2	25.2	6.1	85.1	3.1	4.2
							25.5	25.3	25.3	6.0	84.0	3.0	4.0								
					Middle	9.9	25.5	25.3	25.3	6.0	84.1	3.0	4.0	3.0	25.5	25.3	25.3	6.0	84.1	3.0	4.0
							25.4	25.4	25.4	5.8	81.5	3.3	4.4								
					Bottom	18.8	25.4	25.3	25.3	5.8	81.1	3.3	4.6	3.3	25.4	25.4	25.4	5.8	81.3	3.3	4.5
							25.5	25.4	25.4	6.0	84.5	3.0	4.4								
13/11/13	1450-1510	25/Cloudy	Small Wave	19.4	Surface	1.0	25.4	25.3	25.4	6.1	83.5	3.1	4.0	4.2	25.4	25.3	25.3	5.9	80.8	3.3	4.3
							25.3	25.5	25.5	5.8	80.5	3.3	4.4								
					Middle	9.7	25.2	25.7	25.7	5.6	78.0	3.4	4.4	3.4	25.2	25.7	25.7	5.6	78.4	3.4	4.5
							25.2	25.7	25.7	5.6	78.7	3.4	4.6								
					Bottom	18.4	25.2	25.7	25.7	5.6	78.7	3.4	4.6	3.4	25.2	25.7	25.7	5.6	78.4	3.4	4.5
							25.6	25.3	25.3	6.1	85.6	3.1	4.0								
15/11/13	1555-1614	25/Fine	Small Wave	19.1	Surface	1.0	25.5	25.3	25.3	6.1	85.8	3.1	4.2	4.2	25.5	25.3	25.3	6.0	82.1	3.3	4.3
							25.4	25.4	25.4	5.9	81.8	3.3	4.4								
					Middle	9.6	25.3	25.4	25.4	5.6	79.1	3.4	4.6	3.4	25.3	25.4	25.4	5.6	79.3	3.4	4.5
							25.3	25.5	25.5	5.7	79.4	3.4	4.4								
					Bottom	18.1	25.3	25.5	25.5	5.7	79.4	3.4	4.4	3.4	25.3	25.5	25.5	5.7	79.3	3.4	4.5
							25.6	25.1	25.2	6.1	85.2	3.1	4.0								
18/11/13	1725-1744	25/Fine	Small Wave	19.1	Surface	1.0	25.6	25.1	25.2	6.1	85.5	3.0	4.0	4.2	25.6	25.2	25.2	6.1	85.4	3.1	4.2
							25.5	25.3	25.3	6.0	83.9	3.2	4.3								
					Middle	9.6	25.4	25.3	25.3	6.0	84.3	3.2	4.2	3.2	25.4	25.3	25.3	6.0	84.1	3.2	4.3
							25.3	25.5	25.5	5.6	79.0	3.3	4.4								
					Bottom	18.1	25.3	25.5	25.5	5.6	79.0	3.3	4.4	3.3	25.3	25.5	25.5	5.6	79.2	3.3	4.5
							25.3	25.4	25.4	5.7	79.4	3.4	4.4								

**Mid-Flood Tide**

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)	
							Value	Ave.	Value	Average	Depth-average	Value	Average	Value	Average
20/11/13	0825-0844	22/Cloudy	Small Wave	19.4	Surface	23.4	25.1	6.2	82.3	3.0	4.0	3.0	3.0	4.0	
						23.4	25.2	6.2	82.5	3.0	4.0				
						23.5	25.3	6.1	80.9	3.2	4.2				
					Middle	23.5	25.2	6.1	81.3	3.1	4.0	3.1	3.1	4.1	
						23.5	25.3	5.7	76.1	3.3	4.2				
						23.6	25.4	5.7	76.5	3.3	4.4				
22/11/13	0854-0914	20/Cloudy	Small Wave	20.0	Surface	22.8	28.3	6.6	92.9	3.9	4.8	3.9	3.9	4.9	
						22.8	28.4	6.6	92.4	3.9	5.0				
						22.7	28.4	6.5	90.9	4.0	4.8				
					Middle	22.7	28.3	6.5	91.0	3.9	5.2	3.9	4.0	5.0	
						22.7	28.5	6.2	86.6	4.0	5.0				
						22.7	28.6	6.2	87.3	4.0	5.2				
25/11/13	1153-203	20/Fine	Small Wave	19.2	Surface	23.2	25.4	6.3	83.4	3.9	4.8	3.9	3.9	4.8	
						23.2	25.5	6.3	83.6	3.9	4.8				
						23.3	25.6	6.1	81.5	3.9	4.8				
					Middle	23.3	25.7	6.1	81.2	4.0	5.0	4.0	4.0	4.9	
						23.3	25.7	6.0	80.2	4.0	5.0				
						23.4	25.7	6.0	79.9	4.1	5.2				
27/11/13	1324-1339	21/Cloudy	Small Wave	19.2	Surface	23.2	25.4	6.3	83.7	3.5	4.4	3.5	3.6	4.5	
						23.1	25.3	6.3	83.3	3.6	4.6				
						23.2	25.5	6.2	82.3	3.7	4.8				
					Middle	23.3	25.6	6.2	81.7	3.8	4.6	3.8	3.8	4.7	
						23.3	25.6	5.2	81.1	3.8	4.6				
						23.3	25.6	6.1	81.0	3.5	4.4				
29/11/13	1420-1439	Cloudy	Small Wave	19.8	Surface	21.5	25.1	6.2	81.5	3.8	4.8	3.8	3.8	4.8	
						21.5	25.1	6.2	81.1	3.8	4.8				
						21.6	25.3	6.1	79.8	3.6	4.4				
					Middle	21.7	25.2	6.2	80.8	3.7	4.6	3.7	3.6	4.5	
						21.8	25.4	6.0	78.9	3.9	5.0				
						21.7	25.3	6.1	79.4	4.0	4.8				

**Mid-Ebb Tide**

**Monitoring Station : M4a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
01/11/13	1030-1048	26/Fine	Small Wave	19.6	Surface	25.6	26.6	5.7	26.7	79.4	79.3	3.1	3.2	4.2	4.1			
						25.6	26.7	5.7	26.7	79.2	79.3	3.2	4.0					
						25.4	26.7	5.8	26.8	80.6	80.8	3.3	4.4	4.5				
						25.5	26.8	5.8	26.8	80.9	80.8	3.3	4.6					
						25.3	26.8	5.8	26.8	81.5	81.3	3.4	4.6					
						25.2	26.7	5.8	26.8	81.1	81.3	3.5	4.4					
04/11/13	1215-1230	22/Cloudy	Small Wave	16.2	Surface	25.9	24.7	5.9	24.7	82.6	82.9	3.3	3.3	4.2	4.3			
						25.8	24.7	5.9	24.7	83.1	82.9	3.3	4.4					
						25.8	24.8	5.7	24.8	80.6	80.7	3.4	4.6	4.7				
						25.8	24.7	5.7	24.8	80.8	80.7	3.5	4.8					
						25.7	24.9	5.7	24.9	81.1	81.6	3.2	4.2					
						25.7	24.9	5.8	24.9	82.0	81.6	3.2	4.4					
06/11/13	1350-1410	26/Cloudy	Small Wave	16.2	Surface	25.8	24.6	5.9	24.6	83.3	83.2	3.2	3.3	4.2	4.3			
						25.9	24.6	5.9	24.6	83.0	83.2	3.3	4.4					
						25.8	24.7	5.7	24.8	80.6	80.5	3.4	4.4	4.5				
						25.8	24.8	5.7	24.8	80.3	80.5	3.4	4.6					
						25.7	24.9	5.6	24.9	79.9	80.1	3.2	4.2					
						25.8	24.8	5.7	24.9	80.2	80.1	3.3	4.0					
08/11/13	1550-1610	26/Cloudy	Small Wave	16.4	Surface	25.8	24.6	5.9	24.6	83.3	83.4	3.1	3.1	4.2	4.1			
						25.7	24.5	5.9	24.5	83.5	83.4	3.1	4.0					
						25.6	24.6	5.7	24.7	80.6	80.8	3.3	4.2	4.3				
						25.6	24.7	5.7	24.7	80.9	80.8	3.3	4.4					
						25.5	24.8	5.8	24.8	81.4	81.6	3.2	4.0					
						25.6	24.8	5.8	24.8	81.7	81.6	3.1	4.2					
11/11/13	1850-1910	25/Cloudy	Small Wave	16.0	Surface	25.6	25.2	5.9	25.2	82.9	83.2	3.3	3.3	4.4	4.3			
						25.6	25.2	6.0	25.2	83.4	83.2	3.3	4.2					
						25.5	25.4	5.7	25.4	79.7	79.8	3.5	4.6	4.5				
						25.5	25.3	5.7	25.3	79.9	79.8	3.5	4.4					
						25.5	25.4	5.8	25.5	81.2	81.1	3.7	4.8					
						25.4	25.5	5.8	25.5	81.0	81.1	3.8	4.8					
13/11/13	0848-0900	25/Cloudy	Small Wave	15.6	Surface	25.5	25.4	5.9	25.5	81.5	81.8	3.2	3.2	4.2	4.2			
						25.4	25.5	5.9	25.5	82.1	81.8	3.2	4.2					
						25.3	25.5	5.6	25.6	78.3	78.5	3.4	4.4	4.5				
						25.4	25.6	5.6	25.6	78.7	78.5	3.4	4.6					
						25.3	25.7	5.7	25.7	79.9	79.9	3.6	4.8					
						25.3	25.6	5.7	25.7	79.8	79.9	3.7	5.0					
15/11/13	1020-1039	25/Fine	Small Wave	15.6	Surface	25.5	25.3	5.8	25.3	81.6	81.8	3.2	3.2	4.0	4.1			
						25.4	25.3	5.9	25.3	81.9	81.8	3.3	4.2					
						25.4	25.4	5.6	25.4	78.9	78.8	3.4	4.4	4.5				
						25.3	25.3	5.6	25.4	78.7	78.8	3.4	4.6					
						25.3	25.5	5.8	25.5	81.2	81.0	3.6	4.8					
						25.3	25.4	5.8	25.5	80.8	81.0	3.6	4.7					
18/11/13	1220-1239	25/Fine	Small Wave	15.5	Surface	25.6	25.1	5.9	25.1	82.0	82.2	3.2	3.2	4.2	4.3			
						25.6	25.1	5.9	25.1	82.3	82.2	3.3	4.4					
						25.5	25.3	5.7	25.3	79.2	79.1	3.4	4.4	4.3				
						25.4	25.2	5.6	25.3	79.0	79.1	3.4	4.2					
						25.3	25.4	5.8	25.5	80.8	80.7	3.5	4.6					
						25.4	25.5	5.7	25.5	80.6	80.7	3.5	4.6					

**Mid-Ebb Tide**

**Monitoring Station : M4a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	1320-1339	22/Cloudy	Small Wave	15.6	Surface	23.4	25.3	25.3	25.3	6.0	6.0	79.4	3.2	4.2	4.1	3.3	4.5	4.4
					Middle	23.3	25.3	25.5	25.5	5.8	5.8	79.7	3.1	4.0	4.4			
					Bottom	23.6	25.4	25.5	25.6	5.8	5.9	76.7	3.3	4.4	4.6			
22/11/13	1418-1439	22/Cloudy	Calm	16.2	Surface	23.6	25.6	25.6	25.6	5.9	5.9	78.1	3.4	4.4	4.5	3.5	4.3	4.5
					Middle	22.9	28.4	28.4	28.4	6.6	6.6	91.6	3.4	4.2	4.6			
					Bottom	22.8	28.5	28.5	28.5	6.4	6.4	89.7	3.3	4.2	4.4			
25/11/13	1746-1758	20/Fine	Small Wave	15.6	Surface	22.8	28.5	28.5	28.5	6.5	6.4	89.9	3.4	4.4	4.7	3.8	4.7	4.3
					Middle	22.8	28.5	25.4	25.4	6.1	6.2	90.4	3.6	4.6	4.8			
					Bottom	23.3	25.4	25.6	25.6	6.2	6.1	88.8	3.7	4.6	4.8			
27/11/13	1948-2004	21/Cloudy	Small Wave	15.4	Surface	23.2	25.7	25.7	25.7	5.8	5.9	81.5	3.1	4.2	4.1	3.3	4.1	4.2
					Middle	23.3	25.5	25.5	25.5	6.0	6.1	82.0	3.1	4.0	4.2			
					Bottom	23.2	25.5	25.4	25.4	6.1	6.1	80.8	3.1	4.0	4.0			
29/11/13	0845-0859	Cloudy	Small Wave	0845-0859	Surface	23.3	25.6	25.6	25.6	5.9	5.9	77.5	3.1	4.2	4.1	3.6	4.6	4.5
					Middle	23.3	25.5	25.5	25.5	6.2	6.2	82.0	3.7	4.8	4.8			
					Bottom	23.4	25.7	25.7	25.7	5.9	5.9	82.5	3.8	4.6	4.6			
0845-0859	0845-0859	Cloudy	Small Wave	0845-0859	Surface	23.3	25.4	25.4	25.4	5.1	5.1	80.4	3.1	4.0	4.1	3.6	4.3	4.5
					Middle	23.3	25.4	25.5	25.5	6.2	6.2	80.8	3.1	4.0	4.2			
					Bottom	23.3	25.4	25.4	25.4	6.0	6.0	81.1	3.1	4.0	3.8			

# Mid-Flood Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
01/11/13	1630-1648	26/Fine	Small Wave	19.8	Surface	25.6	26.5	5.7	80.3	3.1	3.1	3.8	3.9	4.0	4.0	4.3	
						25.5	26.5	5.7	80.1	3.1	3.1	4.0					
						25.4	26.7	5.8	81.8	3.2	3.2	4.2					
						25.4	26.8	5.8	81.6	3.2	3.2	4.4					
						25.2	26.8	5.9	82.4	3.3	3.4	4.6					
						25.3	26.9	5.9	82.2	3.4	3.4	4.8					
04/11/13	1742-1758	22/Cloudy	Small Wave	16.4	Surface	25.8	24.6	5.9	84.3	3.3	3.3	4.0	4.1	4.2	4.2	4.6	
						25.8	24.7	5.9	83.7	3.3	3.3	4.2					
						25.8	24.7	5.6	79.0	3.5	3.5	4.6					
						25.7	24.8	5.6	79.3	3.5	3.5	4.8					
						25.7	24.9	6.0	84.5	3.7	3.7	4.8					
						25.8	24.8	5.9	84.3	3.7	3.7	5.0					
06/11/13	0850-0910	26/Cloudy	Small Wave	16.4	Surface	25.8	24.6	5.9	83.9	3.2	3.2	4.2	4.1	4.0	4.0	4.5	
						25.8	24.6	5.9	84.2	3.2	3.2	4.4					
						25.8	24.8	5.7	81.2	3.3	3.3	4.6					
						25.7	24.8	5.8	81.5	3.4	3.4	4.2					
						25.7	24.9	5.8	82.1	3.2	3.2	4.0					
						25.6	24.8	5.8	82.4	3.1	3.1	4.0					
08/11/13	1020-1040	26/Cloudy	Small Wave	16.8	Surface	25.8	24.6	6.0	84.5	3.1	3.1	4.0	4.1	4.2	4.2	4.3	
						25.8	24.6	6.0	84.9	3.1	3.1	4.2					
						25.6	24.7	5.8	81.8	3.2	3.2	4.4					
						25.7	24.8	5.8	82.2	3.3	3.3	4.2					
						25.6	24.9	5.8	82.5	3.1	3.1	4.0					
						25.5	24.8	5.9	83.1	3.1	3.1	3.8					
11/11/13	1318-1330	25/Cloudy	Calm	16.4	Surface	25.5	25.2	6.1	85.4	3.1	3.1	4.0	4.1	4.2	4.2	4.3	
						25.6	25.2	6.1	85.1	3.1	3.1	4.2					
						25.5	25.3	6.0	84.1	3.3	3.3	4.4					
						25.4	25.4	6.0	83.9	3.3	3.3	4.4					
						25.4	25.5	6.0	83.2	3.5	3.6	4.6					
						25.4	25.4	5.9	82.9	3.6	3.6	4.4					
13/11/13	1518-1530	25/Cloudy	Small Wave	15.8	Surface	25.4	25.5	5.9	82.4	3.1	3.1	3.8	4.0	4.2	4.2	4.4	
						25.5	25.4	6.0	83.0	3.1	3.1	4.4					
						25.4	25.5	5.7	79.2	3.3	3.3	4.4					
						25.3	25.5	5.7	79.5	3.3	3.3	4.6					
						25.3	25.5	5.8	80.8	3.5	3.6	4.6					
						25.2	25.6	5.8	80.6	3.6	3.6	4.8					
15/11/13	1620-1639	25/Fine	Small Wave	15.8	Surface	25.5	25.4	5.9	82.8	3.2	3.2	4.0	4.1	4.2	4.2	4.4	
						25.5	25.4	6.0	83.0	3.1	3.1	4.4					
						25.4	25.4	5.7	79.9	3.3	3.4	4.6					
						25.3	25.5	5.7	80.2	3.4	3.5	4.8					
						25.3	25.5	5.8	81.5	3.5	3.5	4.6					
						25.3	25.6	5.8	81.7	3.5	3.5	4.8					
18/11/13	1750-1809	25/Fine	Small Wave	15.8	Surface	25.5	25.2	5.9	82.8	3.2	3.2	4.2	4.1	4.0	4.0	4.4	
						25.6	25.2	5.9	83.1	3.2	3.2	4.4					
						25.4	25.4	5.7	80.2	3.3	3.3	4.4					
						25.5	25.3	5.8	80.5	3.3	3.3	4.6					
						25.3	25.5	5.8	81.8	3.4	3.4	4.6					
						25.4	25.5	5.8	82.1	3.5	3.5	4.8					

# Mid-Flood Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	0850-0909	22/Cloudy	Small Wave	16.2	Surface	23.4	25.2	25.2	6.0	80.0	3.1	4.2	3.1	4.2	4.1	4.2	
					Middle	23.3	25.2	5.8	77.5	3.1	4.0						
					Bottom	23.4	25.3	5.8	77.7	3.3	4.2						
22/11/13	0918-0938	20/Cloudy	Small Wave	16.8	Surface	23.6	25.5	25.5	5.9	78.7	3.4	4.4	3.4	4.4	4.3	4.5	
					Middle	23.5	25.4	6.0	79.0	3.4	4.2						
					Bottom	22.8	28.4	6.5	91.5	3.2	4.2						
25/11/13	1208-1225	20/Fine	Small Wave	16.0	Surface	22.9	28.4	28.4	6.5	91.2	3.2	4.4	3.2	4.4	4.3	4.5	
					Middle	22.8	28.3	6.3	88.7	3.5	4.6						
					Bottom	22.7	28.3	6.4	89.3	3.5	4.8						
27/11/13	1348-1404	21/Cloudy	Small Wave	15.8	Surface	22.8	28.2	28.2	6.1	84.5	3.6	4.4	3.6	4.4	4.7	4.6	
					Middle	27.8	28.2	6.2	84.8	3.6	4.4						
					Bottom	23.1	25.4	6.2	82.2	3.4	4.2						
29/11/13	1446-1458	Cloudy	Small Wave	16.2	Surface	23.2	25.4	25.4	6.2	82.4	3.4	4.2	3.4	4.2	4.3	4.4	
					Middle	23.3	25.6	6.1	80.6	3.6	4.6						
					Bottom	23.2	25.6	6.0	80.3	3.7	4.8						
20/11/13	0850-0909	22/Cloudy	Small Wave	16.2	Surface	23.3	25.7	25.7	6.4	85.4	3.9	4.6	3.9	4.6	4.7	4.6	
					Middle	23.3	25.7	6.5	86.2	3.9	4.8						
					Bottom	23.3	25.3	6.2	82.7	3.6	4.6						
27/11/13	1348-1404	21/Cloudy	Small Wave	15.8	Surface	23.2	25.3	25.3	6.2	83.2	3.7	4.8	3.7	4.8	4.7	4.2	
					Middle	23.4	25.4	6.1	81.1	3.0	4.0						
					Bottom	23.3	25.5	6.2	81.9	3.1	4.2						
29/11/13	1446-1458	Cloudy	Small Wave	16.2	Surface	23.4	25.5	25.6	5.9	78.6	3.0	3.8	3.0	3.8	3.9	4.4	
					Middle	23.5	25.6	6.0	79.1	3.0	4.0						
					Bottom	21.6	25.1	6.1	79.3	3.6	4.4						
20/11/13	0850-0909	22/Cloudy	Small Wave	16.2	Surface	21.6	25.2	25.2	6.1	79.8	3.6	4.2	3.6	4.2	4.3	4.4	
					Middle	21.7	25.3	6.0	78.6	3.8	4.8						
					Bottom	21.8	25.2	6.0	78.9	3.9	5.0						
25/11/13	1208-1225	20/Fine	Small Wave	16.0	Surface	21.8	25.4	25.4	5.9	77.4	3.1	4.0	3.1	4.0	4.0	4.5	
					Middle	21.8	25.4	6.0	78.2	3.1	4.0						
					Bottom	21.8	25.3	6.0	78.2	3.1	4.0						

**Mid-Ebb Tide**

**Monitoring Station : M5**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
01/11/13	1054-1112	26/Fine	Small Wave	14.2	Surface	25.6	26.7	26.7	26.7	5.6	5.6	78.4	3.3	4.2	4.2	4.4	4.4	4.3
					Middle	25.5	26.6	26.6	26.6	5.6	5.6	79.0	3.3	3.3	3.3	4.0	4.0	4.1
					Bottom	25.4	26.8	26.8	26.8	5.7	5.7	79.5	3.2	3.2	3.2	4.2	4.2	4.2
04/11/13	1245-1300	22/Cloudy	Small Wave	14.4	Surface	25.2	26.8	26.8	26.8	5.5	5.5	76.9	3.1	4.0	4.0	4.0	4.4	4.2
					Middle	25.3	26.8	26.8	26.8	5.5	5.5	77.1	3.1	3.1	3.1	4.4	4.4	4.1
					Bottom	25.9	24.6	24.6	24.7	6.0	6.0	84.7	3.3	3.3	3.3	4.2	4.2	4.1
06/11/13	1415-1435	26/Cloudy	Small Wave	14.4	Surface	25.8	24.7	24.7	24.7	5.9	6.0	84.1	3.2	4.0	4.0	4.4	4.4	4.3
					Middle	25.7	24.7	24.7	24.7	5.8	5.8	84.4	3.7	3.7	3.7	4.8	4.8	4.7
					Bottom	25.8	24.7	24.7	24.7	5.8	5.8	84.7	3.7	3.7	3.7	4.6	4.6	4.4
08/11/13	1615-1635	26/Cloudy	Small Wave	14.2	Surface	25.6	24.8	24.8	24.8	5.7	5.7	80.8	3.1	4.0	4.0	4.0	4.0	4.0
					Middle	25.7	24.6	24.6	24.6	6.0	6.0	85.2	3.1	3.1	3.1	4.4	4.4	4.3
					Bottom	25.5	24.7	24.7	24.7	5.9	5.9	83.7	3.6	3.6	3.6	4.8	4.8	4.7
11/11/13	1914-1931	25/Cloudy	Small Wave	14.2	Surface	25.4	25.4	25.4	25.4	5.6	5.6	77.9	3.9	4.8	4.8	5.2	5.2	5.0
					Middle	25.4	25.5	25.5	25.5	5.6	5.6	78.1	4.0	4.0	4.0	4.0	4.0	4.0
					Bottom	25.5	24.8	24.8	24.8	5.8	5.8	82.0	3.0	3.0	3.0	4.0	4.0	4.0
13/11/13	0906-0926	25/Cloudy	Small Wave	13.8	Surface	25.6	25.3	25.3	25.3	5.8	5.8	80.8	3.3	4.2	4.2	4.2	4.1	4.1
					Middle	25.5	25.2	25.2	25.2	5.8	5.8	81.0	3.3	3.3	3.3	4.4	4.4	4.3
					Bottom	25.5	25.4	25.4	25.4	5.8	5.8	80.3	3.2	3.2	3.2	4.4	4.4	4.3
15/11/13	1045-1104	25/Fine	Small Wave	13.9	Surface	25.3	25.7	25.7	25.7	5.5	5.5	76.5	3.8	4.4	4.4	4.4	4.6	4.6
					Middle	25.4	25.7	25.7	25.7	5.5	5.5	76.9	3.9	3.9	3.9	4.8	4.8	4.6
					Bottom	25.6	25.4	25.4	25.4	5.7	5.7	79.9	3.3	3.3	3.3	4.2	4.2	4.3
18/11/13	1245-1304	25/Fine	Small Wave	13.9	Surface	25.5	25.4	25.4	25.4	5.6	5.6	78.9	3.2	4.0	4.0	4.0	4.1	4.1
					Middle	25.5	25.5	25.5	25.5	5.6	5.6	78.6	3.2	3.2	3.2	4.2	4.2	4.1
					Bottom	25.3	25.6	25.6	25.6	5.6	5.6	77.7	3.8	3.8	3.8	4.8	4.8	5.0



**Mid-Ebb Tide**

**Monitoring Station : M5**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	1345-1404	22/Cloudy	Small Wave	14.4	Surface	1.0	23.3	25.3	5.8	5.8	77.4	3.2	4.2	3.3	4.2	4.3	4.3	
							23.4	25.3	5.8	77.7	3.2	4.4						
							23.5	25.4	5.7	76.4	3.1	4.0						
					Middle	7.2	23.4	25.5	5.7	76.5	3.1	3.8						
							23.5	25.6	5.7	75.4	3.7	4.6						
							23.6	25.5	5.7	75.7	3.7	4.8						
Bottom	13.4	22.8	28.5	6.5	91.0	3.6	4.8											
		22.8	28.5	6.4	90.0	3.6	4.6											
		22.8	28.5	6.3	88.0	3.4	4.4											
22/11/13	1442-1503	22/Cloudy	Calm	14.2	Surface	1.0	22.8	28.5	6.3	6.3	88.5	3.4	4.2	3.4	4.2	4.3	4.4	
							22.7	28.5	6.3	88.5	3.4	4.2						
							22.7	28.5	6.1	86.8	3.3	4.2						
					Middle	7.1	22.7	28.5	6.1	85.8	3.3	4.4						
							23.3	25.4	6.4	85.4	3.4	4.0						
							23.2	25.4	6.4	85.1	3.4	4.4						
Bottom	13.2	23.2	25.6	6.4	84.4	3.6	4.4											
		23.2	25.5	6.3	83.9	3.7	4.8											
		23.1	25.6	6.2	82.0	3.6	4.6											
25/11/13	1806-1823	20/Fine	Small Wave	13.6	Surface	1.0	23.1	25.7	6.2	6.2	82.3	3.6	4.8	3.5	4.8	4.7	4.5	
							23.2	25.4	6.5	85.8	3.4	4.2						
							23.1	25.3	6.4	85.6	3.4	4.4						
					Middle	6.8	23.2	25.4	6.4	84.8	3.6	4.6						
							23.3	25.5	6.4	84.4	3.7	4.8						
							23.3	25.7	6.2	82.3	3.6	4.6						
Bottom	12.6	23.4	25.7	6.2	82.6	3.5	4.4											
		21.5	24.9	6.1	79.4	3.7	4.6											
		21.5	25.0	6.1	79.6	3.7	4.4											
27/11/13	2013-2029	21/Cloudy	Small Wave	13.6	Surface	1.0	21.6	25.3	5.9	5.9	76.9	3.7	4.8	3.5	4.8	4.7	4.5	
							21.7	25.3	5.9	77.2	3.7	4.6						
							21.8	25.4	6.1	80.0	3.8	5.0						
					Middle	6.8	21.8	25.4	6.1	79.8	3.8	4.8						
							21.8	25.4	6.1	79.8	3.8	4.8						
							21.8	25.4	6.1	79.8	3.8	4.8						
Bottom	12.8	21.8	25.4	6.1	79.8	3.8	4.8											
		21.8	25.4	6.1	79.8	3.8	4.8											
		21.8	25.4	6.1	79.8	3.8	4.8											
29/11/13	0908-0925	Cloudy	Small Wave	13.8	Surface	1.0	21.8	25.4	6.1	6.1	79.9	3.8	4.8	3.7	4.8	4.7	4.7	
							21.8	25.4	6.1	79.9	3.8	4.8						
							21.8	25.4	6.1	79.9	3.8	4.8						
					Middle	6.9	21.8	25.3	5.9	77.1	3.7	4.8						
							21.7	25.3	5.9	77.2	3.7	4.6						
							21.8	25.4	6.1	80.0	3.8	5.0						
Bottom	12.8	21.8	25.4	6.1	79.8	3.8	4.8											
		21.8	25.4	6.1	79.8	3.8	4.8											
		21.8	25.4	6.1	79.8	3.8	4.8											

# Mid-Flood Tide

Monitoring Station : M5

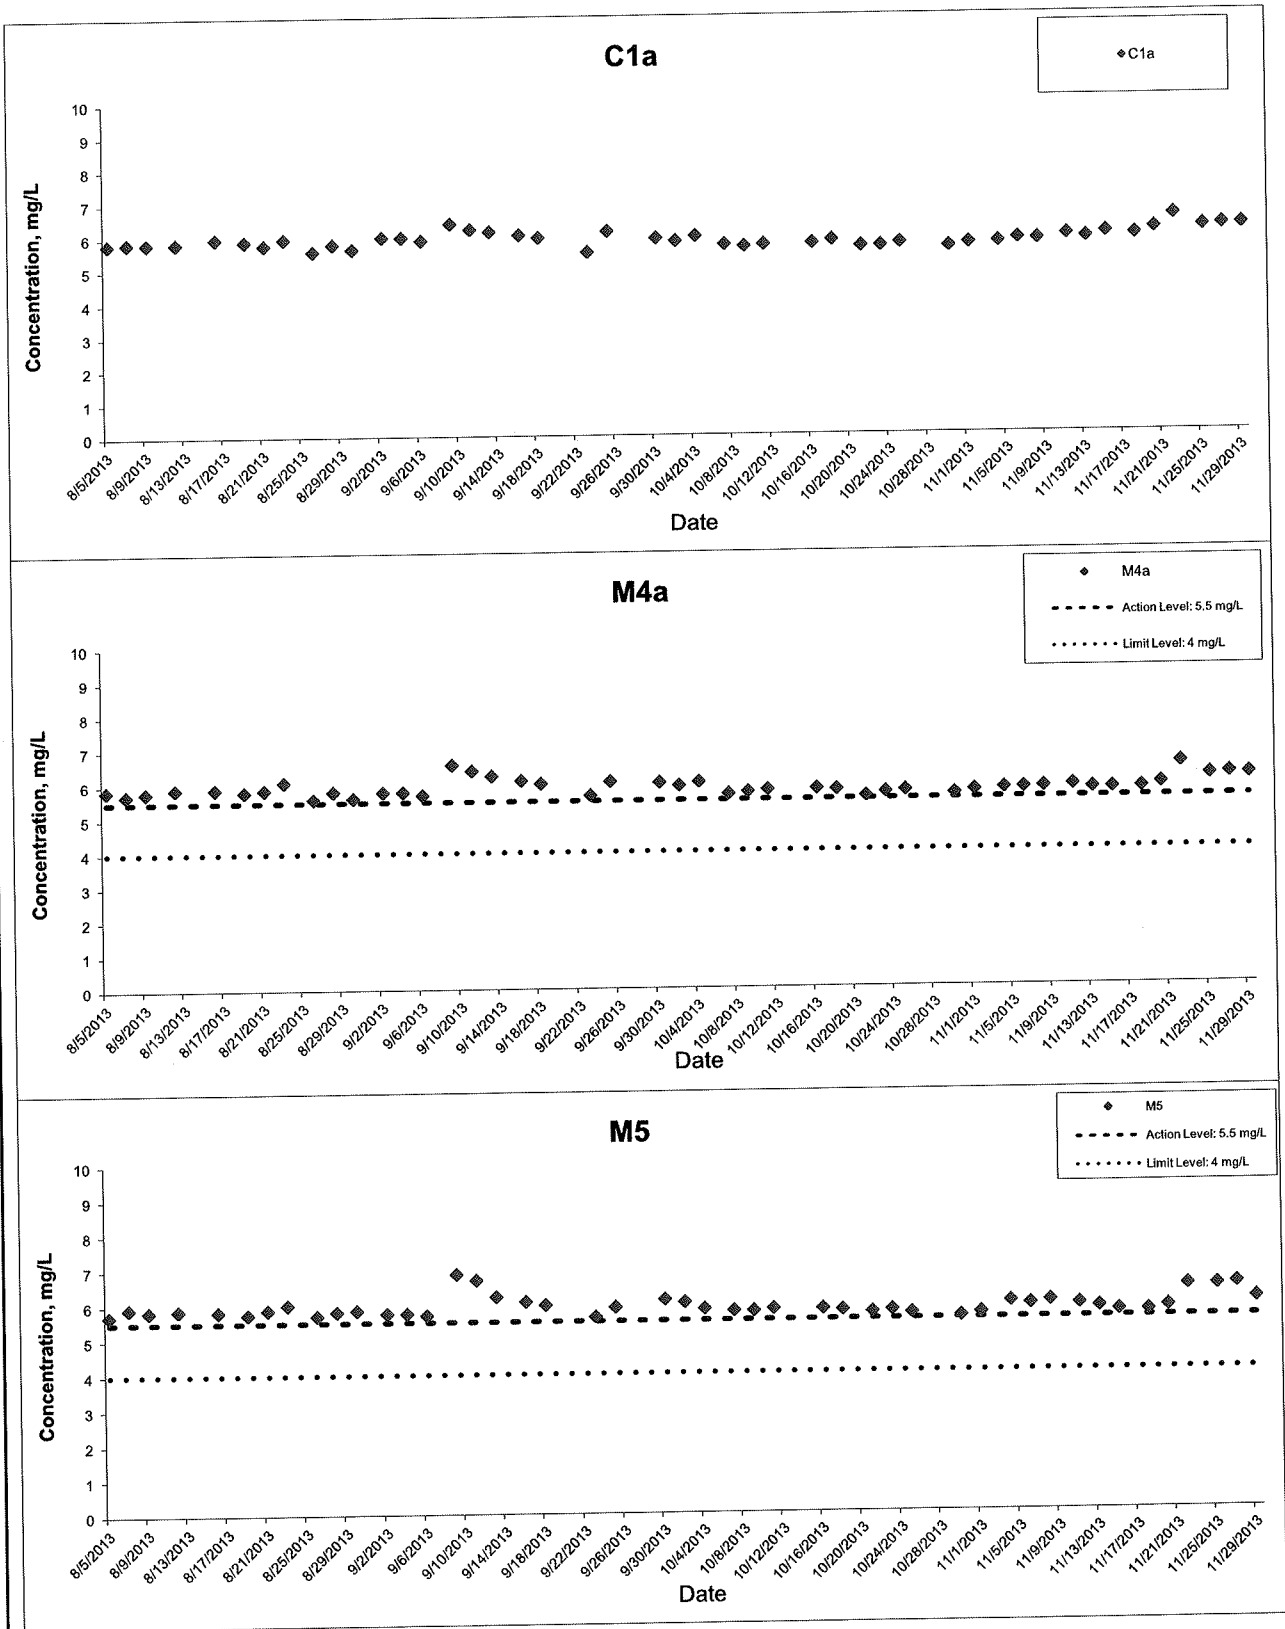
Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
01/11/13	1654-1712	26/Fine	Small Wave	14.8	Surface	25.5	26.6	5.7	26.6	79.2	79.5	3.2	3.2	4.2	4.3	4.1		
						25.5	26.6	5.7	26.6	79.8	79.5	3.2	3.2	4.4	4.3			
						25.4	26.6	5.7	26.7	80.0	80.2	3.1	3.1	4.0	4.0			
						25.5	26.7	5.7	26.7	80.4	80.2	3.1	3.1	4.0	4.0			
						25.4	26.9	5.6	26.9	77.9	77.8	3.0	3.0	3.8	3.9			
						25.3	26.8	5.6	26.8	77.6	77.6	3.0	3.0	4.0	4.0			
04/11/13	1820-1840	22/Cloudy	Small Wave	14.6	Surface	25.9	24.7	5.9	24.7	82.9	83.0	3.4	3.4	4.6	4.4	4.4		
						25.8	24.7	5.9	24.7	83.1	83.0	3.4	3.4	4.2	4.2			
						25.8	24.8	5.7	24.8	81.3	81.1	3.3	3.3	4.2	4.2			
						25.8	24.7	5.7	24.7	80.9	81.1	3.2	3.3	4.4	4.3			
						25.7	24.8	5.6	24.8	79.1	79.3	3.5	3.5	4.6	4.5			
						25.8	24.7	5.6	24.7	79.4	79.4	3.5	3.5	4.4	4.4			
06/11/13	0915-0935	26/Cloudy	Small Wave	14.6	Surface	25.8	24.6	6.1	24.7	85.7	85.9	3.2	3.2	4.4	4.3	4.3		
						25.9	24.7	6.1	24.7	86.0	85.9	3.2	3.2	4.2	4.2			
						25.8	24.7	5.9	24.8	84.2	84.4	3.6	3.7	4.8	4.7			
						25.8	24.8	6.0	24.8	84.5	84.4	3.7	3.7	4.6	4.6			
						25.7	24.9	5.8	24.9	82.4	82.6	3.0	3.0	4.0	4.0			
						25.7	24.9	5.8	24.9	82.8	82.6	3.0	3.0	3.8	3.9			
08/11/13	1045-1105	26/Cloudy	Small Wave	14.8	Surface	25.7	24.6	6.1	24.7	86.4	86.6	3.1	3.1	4.2	4.1	4.2		
						25.8	24.7	6.1	24.7	86.7	86.6	3.1	3.1	4.0	4.0			
						25.7	24.8	6.0	24.8	85.0	85.1	3.6	3.6	4.6	4.6			
						25.7	24.7	6.0	24.7	85.2	85.1	3.6	3.6	4.8	4.7			
						25.7	24.8	5.9	24.9	83.2	83.4	3.0	3.0	3.8	3.9			
						25.6	24.9	5.9	24.9	83.5	83.4	3.0	3.0	4.0	4.0			
11/11/13	1336-1356	25/Cloudy	Calm	14.8	Surface	25.6	25.2	6.0	25.2	84.3	84.5	3.2	3.2	4.2	4.1	4.4		
						25.6	25.2	6.1	25.2	84.6	84.5	3.1	3.1	4.0	4.0			
						25.5	25.3	6.1	25.3	85.4	85.8	3.4	3.4	4.6	4.5			
						25.4	25.3	6.2	25.3	86.2	85.8	3.4	3.4	4.4	4.4			
						25.4	25.4	5.9	25.5	81.6	81.8	3.6	3.6	4.8	4.7			
						25.4	25.5	5.9	25.5	81.9	81.8	3.5	3.6	4.6	4.6			
13/11/13	1536-1556	25/Cloudy	Small Wave	14.2	Surface	25.4	25.4	5.9	25.5	81.7	81.8	3.2	3.2	4.2	4.1	4.4		
						25.3	25.5	5.9	25.5	81.9	81.8	3.2	3.2	4.0	4.0			
						25.3	25.6	5.8	25.6	81.1	81.2	3.1	3.1	4.2	4.2			
						25.4	25.5	5.8	25.6	81.3	81.2	3.2	3.1	4.4	4.3			
						25.2	25.6	5.6	25.7	77.4	77.6	3.7	3.8	4.6	4.7			
						25.3	25.7	5.6	25.7	77.7	77.6	3.8	3.8	4.8	4.7			
15/11/13	1645-1704	25/Fine	Small Wave	14.1	Surface	25.4	25.3	5.9	25.4	82.0	82.2	3.2	3.3	4.2	4.3	4.4		
						25.5	25.4	5.9	25.4	82.3	82.2	3.3	3.3	4.4	4.4			
						25.4	25.4	5.8	25.4	81.0	81.2	3.1	3.1	4.2	4.2			
						25.4	25.4	5.8	25.4	81.3	81.2	3.1	3.1	4.0	4.1			
						25.3	25.5	5.6	25.5	78.8	78.9	3.7	3.7	4.6	4.7			
						25.2	25.4	5.6	25.4	78.9	78.9	3.7	3.7	4.8	4.7			
18/11/13	1815-1834	25/Fine	Small Wave	14.1	Surface	25.5	25.1	5.8	25.1	80.7	80.9	3.2	3.2	4.2	4.3	4.4		
						25.5	25.1	5.8	25.1	81.0	80.9	3.2	3.2	4.4	4.4			
						25.4	25.2	5.7	25.3	79.7	79.8	3.1	3.1	4.0	4.1			
						25.4	25.3	5.7	25.3	79.9	79.8	3.1	3.1	4.2	4.2			
						25.3	25.5	5.6	25.5	79.0	79.1	3.8	3.8	4.8	4.7			
						25.3	25.4	5.6	25.4	79.2	79.2	3.8	3.8	4.6	4.6			

**Mid-Flood Tide**

Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
20/11/13	0915-0934	22/Cloudy	Small Wave	14.6	Surface	23.4	25.2	5.9	78.1	3.1	3.1	4.2	3.3	4.2	4.1			
						23.5	25.1	5.9	78.2	3.1	4.0							
						23.4	25.3	5.8	76.9	3.0	4.2							
					Middle	23.4	25.3	5.8	77.3	3.0	4.0							
						23.6	25.4	5.7	76.1	3.7	4.6							
						23.6	25.5	5.7	76.3	3.7	4.8							
22/11/13	0942-1002	20/Cloudy	Small Wave	14.8	Surface	22.8	28.4	6.6	92.4	3.5	3.5	4.4	3.6	4.4	4.3			
						22.8	28.3	6.7	93.2	3.6	4.2							
						22.8	28.3	6.5	90.5	3.7	4.6							
					Middle	22.8	28.3	6.4	89.9	3.6	4.4							
						22.7	28.3	6.2	86.8	3.4	4.6							
						22.7	28.3	6.2	87.3	3.5	4.4							
25/11/13	1238-1258	20/Fine	Small Wave	14.0	Surface	23.2	25.5	6.3	83.6	3.3	3.3	4.2	3.7	4.2	4.1			
						23.2	25.4	6.3	83.9	3.3	4.0							
						23.3	25.6	6.2	82.6	3.8	4.8							
					Middle	23.3	25.6	6.3	83.6	3.8	5.0							
						23.3	25.6	6.1	81.5	3.9	5.0							
						23.3	25.7	6.2	81.8	3.9	5.2							
27/11/13	1413-1429	21/Cloudy	Small Wave	14.0	Surface	23.2	25.3	6.5	86.5	3.3	3.3	4.4	3.5	4.4	4.3			
						23.3	25.5	6.5	86.3	3.3	4.2							
						23.3	25.4	6.4	85.5	3.5	4.6							
					Middle	23.3	25.4	6.4	85.1	3.6	4.8							
						23.5	25.6	6.3	83.1	3.5	4.4							
						23.4	25.6	6.3	83.4	3.5	4.6							
29/11/13	1507-1524	Cloudy	Small Wave	14.4	Surface	21.6	25.2	6.2	81.1	3.6	3.6	4.8	3.5	4.8	4.5			
						21.5	25.1	6.2	80.7	3.6	4.6							
						21.7	25.2	6.1	80.2	3.5	4.6							
					Middle	21.8	25.3	6.1	79.9	3.6	4.4							
						21.8	25.4	6.0	78.3	3.3	4.4							
						21.8	25.4	6.0	78.6	3.4	4.2							

## Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide



This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

**HONG KONG - ZHUHAI - MACAO BRIDGE  
HONG KONG BOUNDARY CROSSING FACILITIES  
- RECLAMATION WORKS**

**Graphical Presentation of Impact Water Quality  
Monitoring Results**




Project No.: 60249820

Date: December 2013

Appendix C

## Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

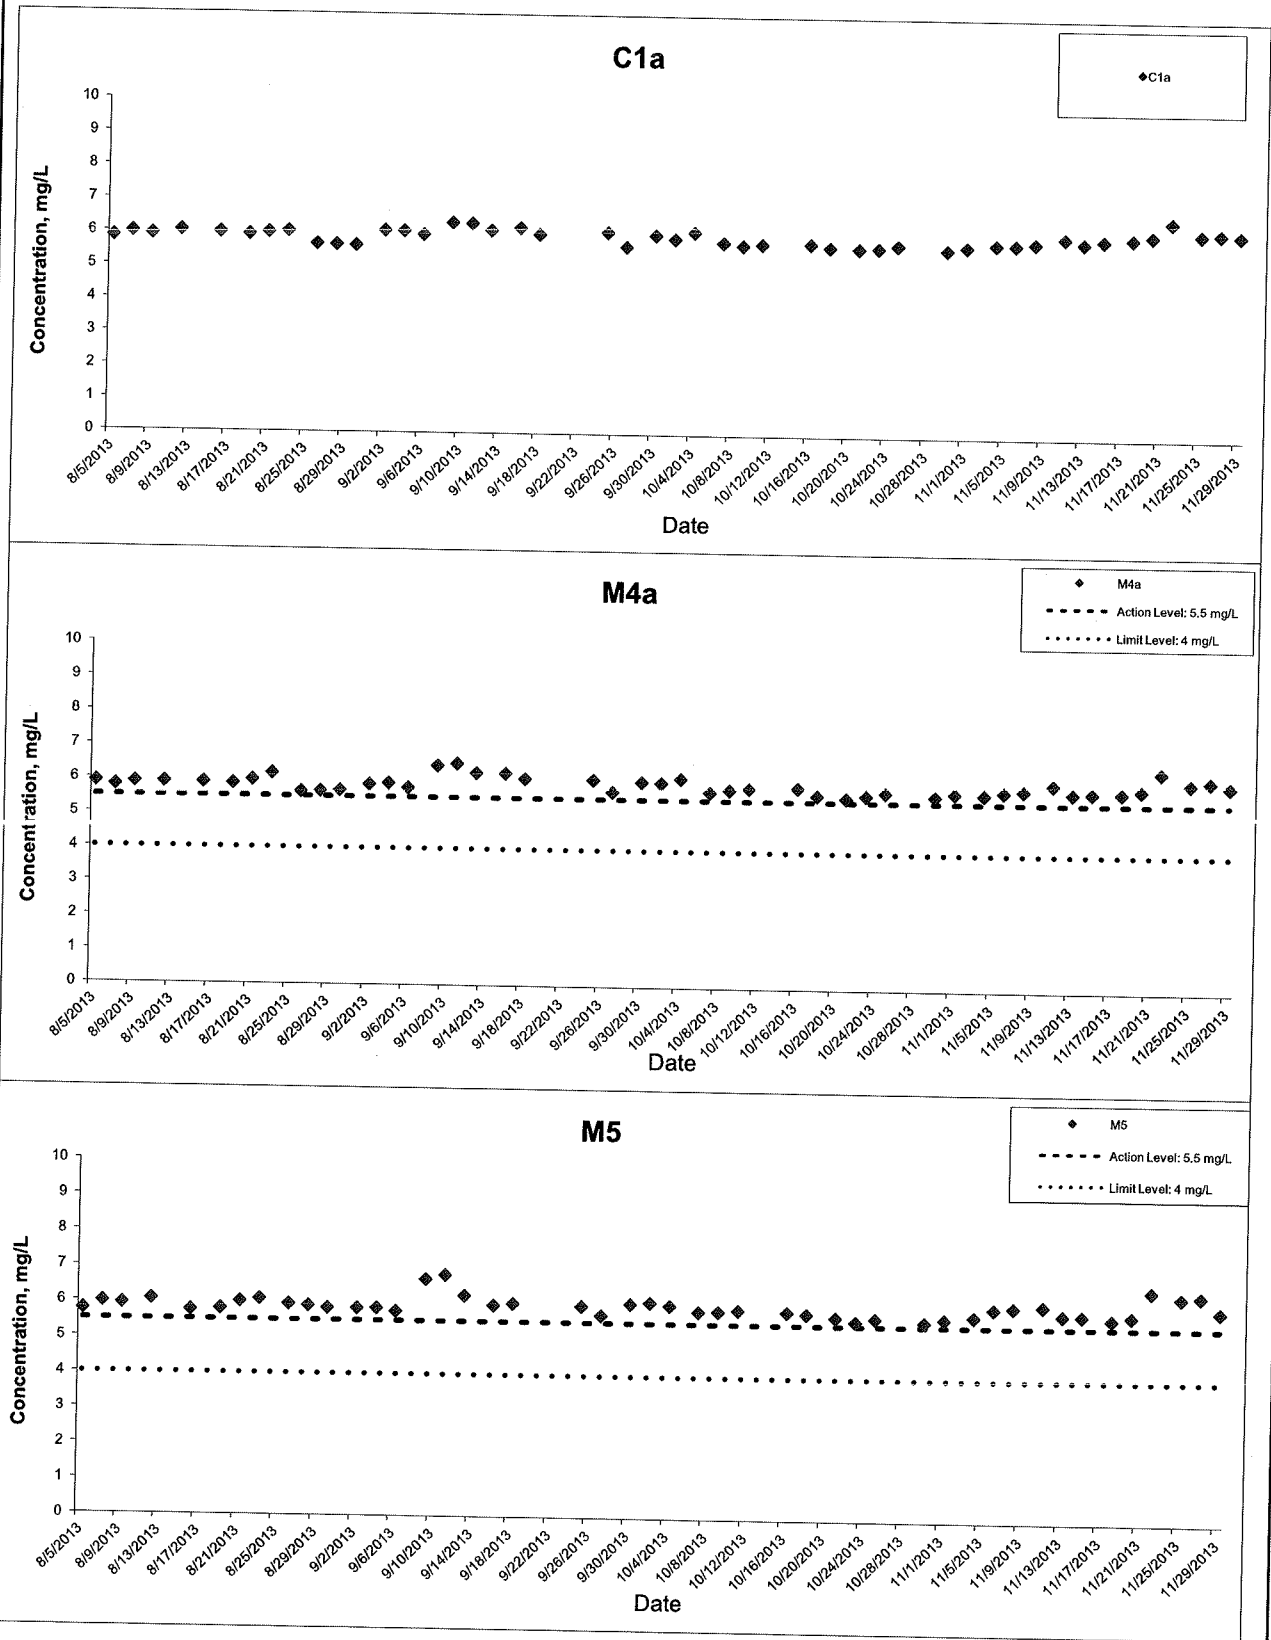

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

**HONG KONG - ZHUHAI - MACAO BRIDGE  
HONG KONG BOUNDARY CROSSING FACILITIES  
- RECLAMATION WORKS**

**Graphical Presentation of Impact Water Quality  
Monitoring Results**




Project No.: 60249820

Date: December 2013

Appendix C

### Dissolved Oxygen (Bottom) at Mid-Ebb Tide

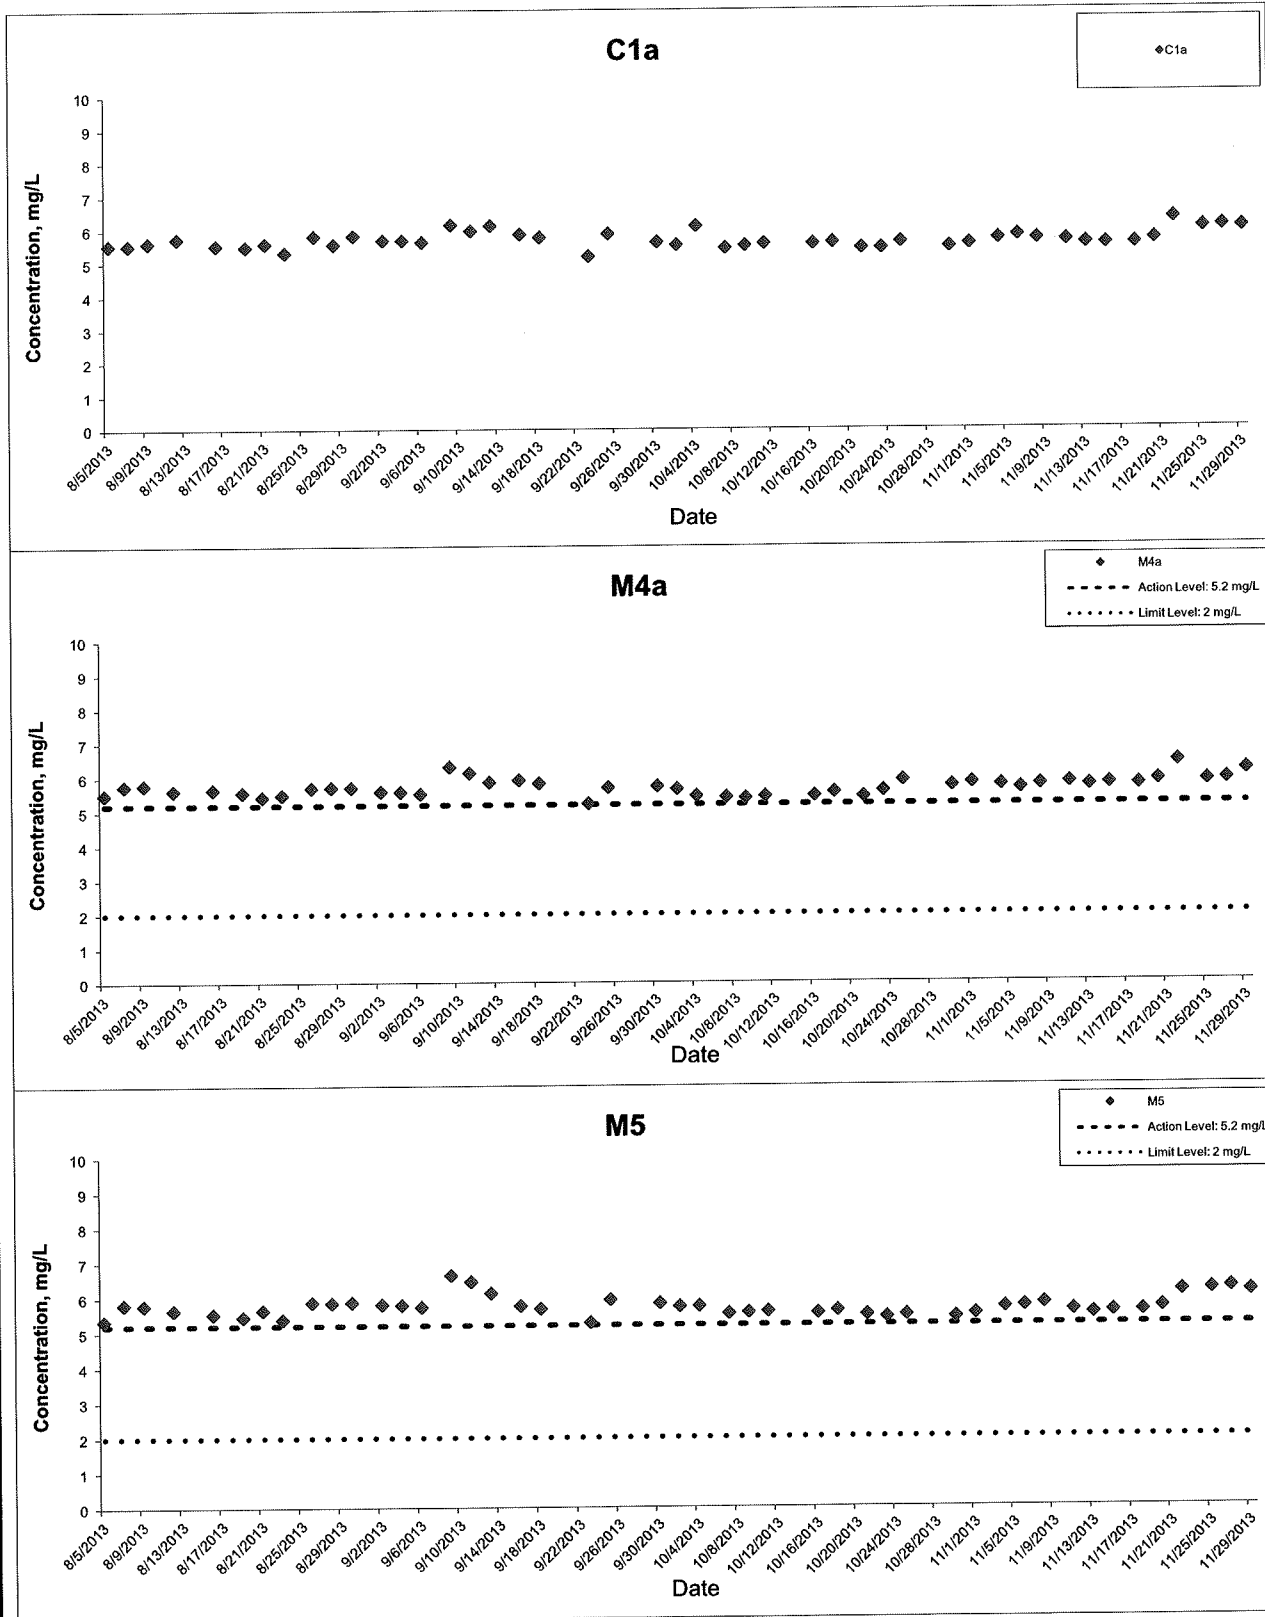

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

HONG KONG - ZHUHAI - MACAO BRIDGE  
 HONG KONG BOUNDARY CROSSING FACILITIES  
 - RECLAMATION WORKS

Graphical Presentation of Impact Water Quality  
 Monitoring Results




Project No.: 60249820

Date: December 2013

Appendix C

### Dissolved Oxygen (Bottom) at Mid-Flood Tide

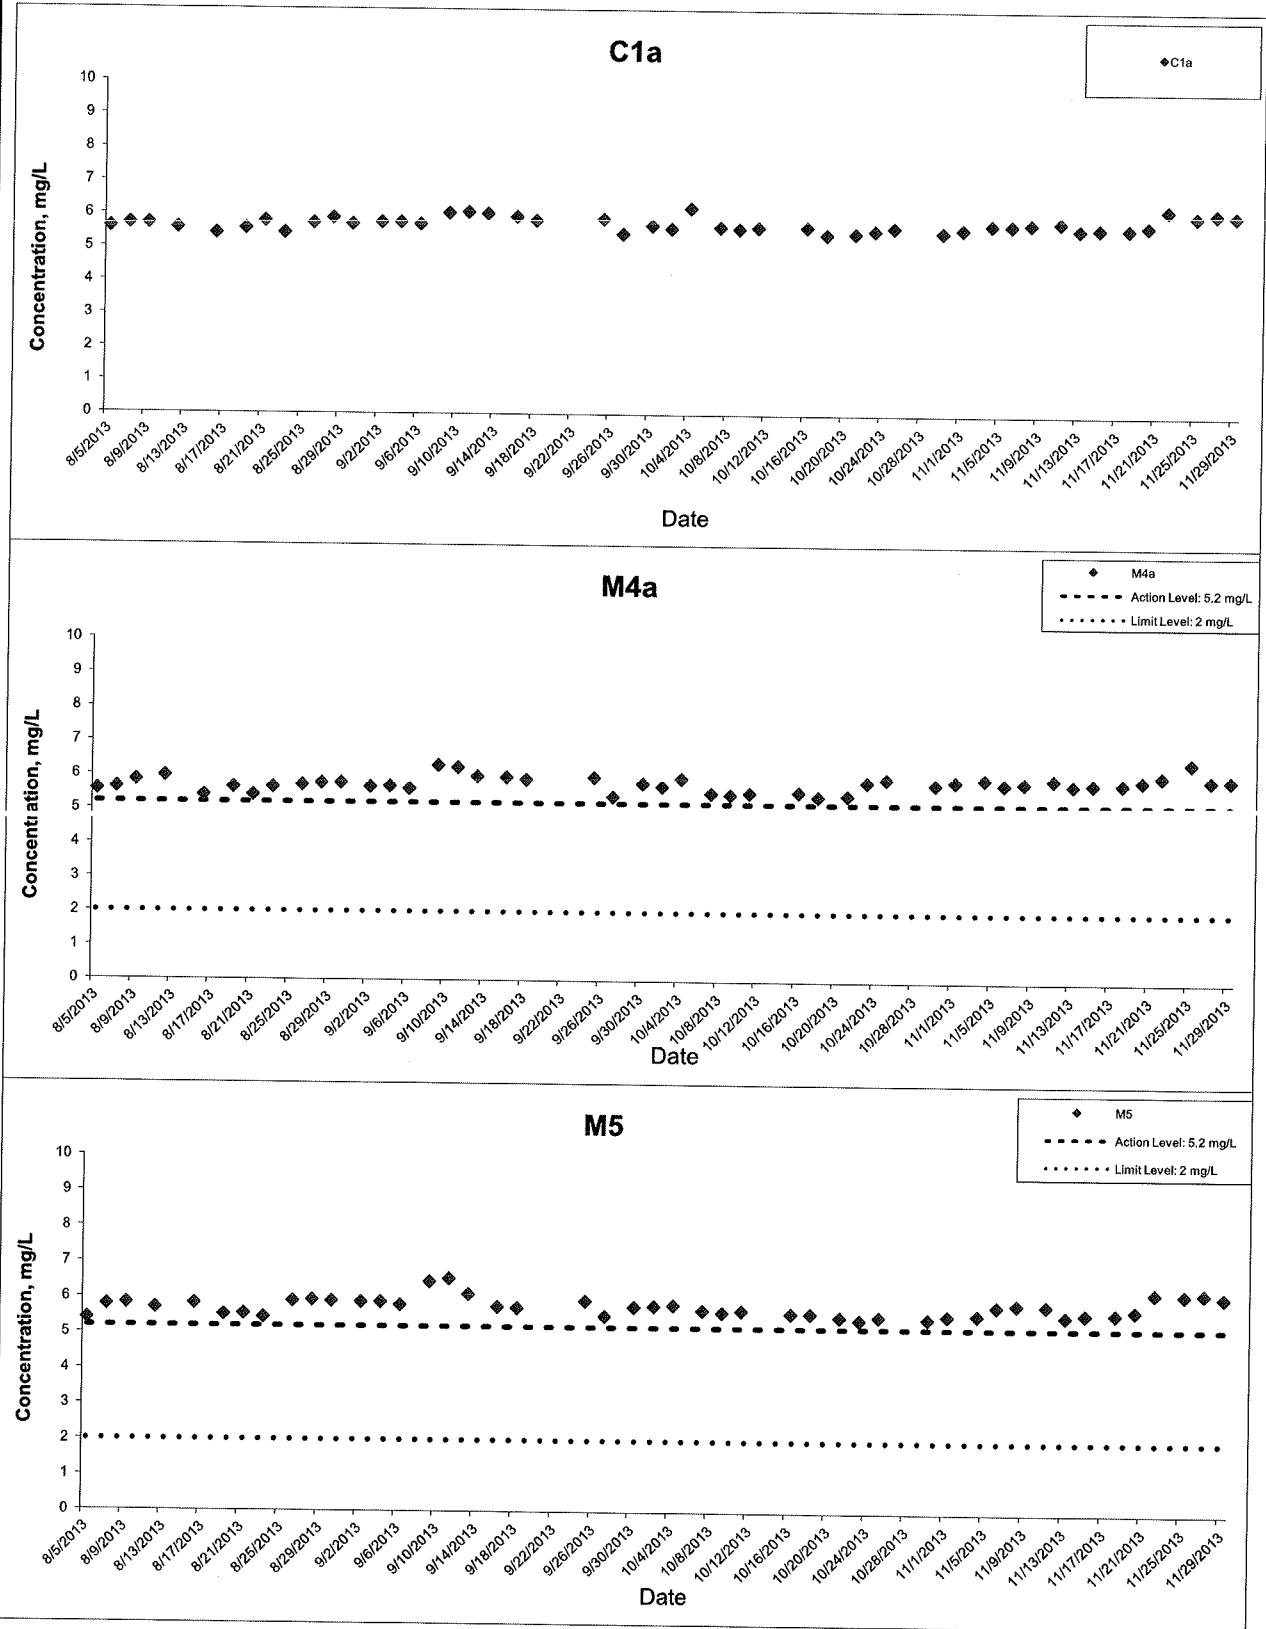

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

HONG KONG - ZHUHAI - MACAO BRIDGE

HONG KONG BOUNDARY CROSSING FACILITIES

- RECLAMATION WORKS

Graphical Presentation of Impact Water Quality  
Monitoring Results






Project No.: 60249820

Date: December 2013

Appendix C

### Turbidity at Mid-Ebb Tide

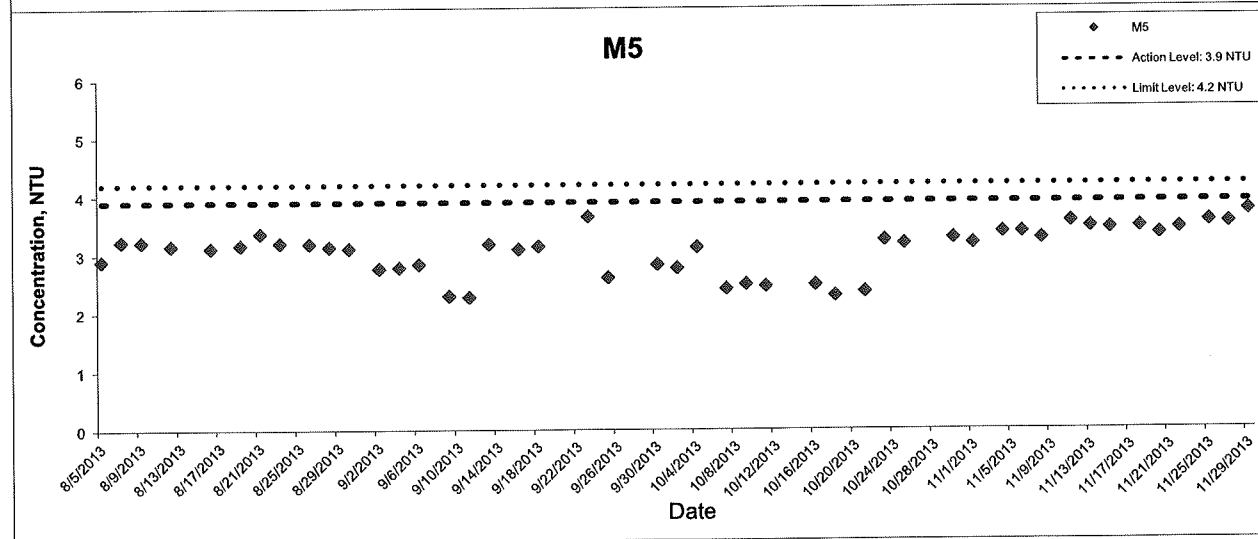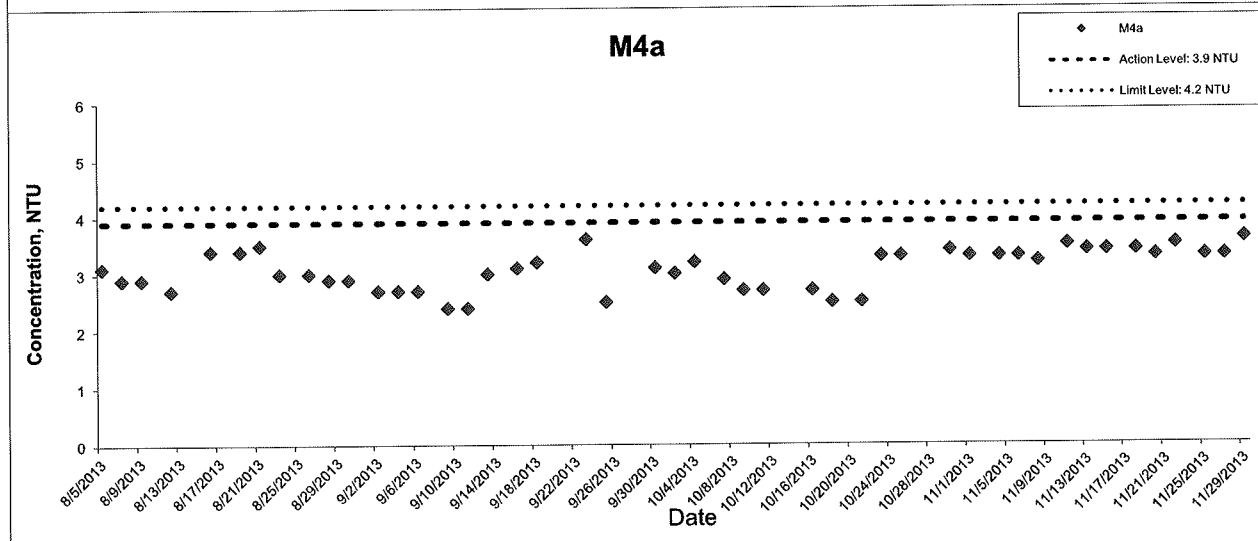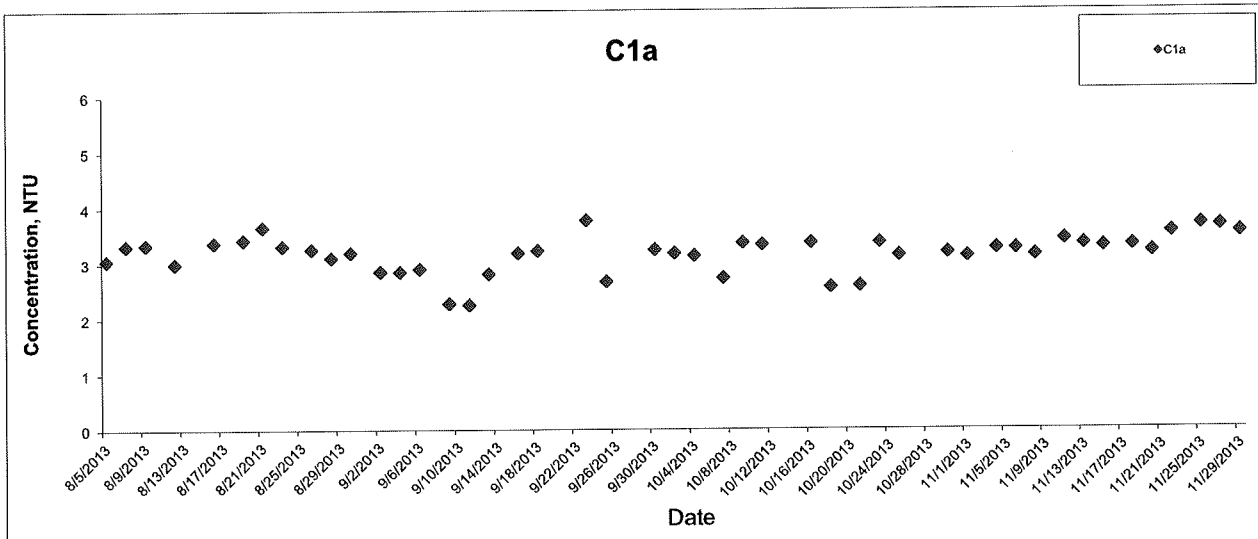

This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

**HONG KONG - ZHUHAI - MACAO BRIDGE**  
**HONG KONG BOUNDARY CROSSING FACILITIES**  
**- RECLAMATION WORKS**

**Graphical Presentation of Impact Water Quality**  
**Monitoring Results**




Project No.: 60249820

Date: December 2013

Appendix C



### Turbidity at Mid-Flood Tide

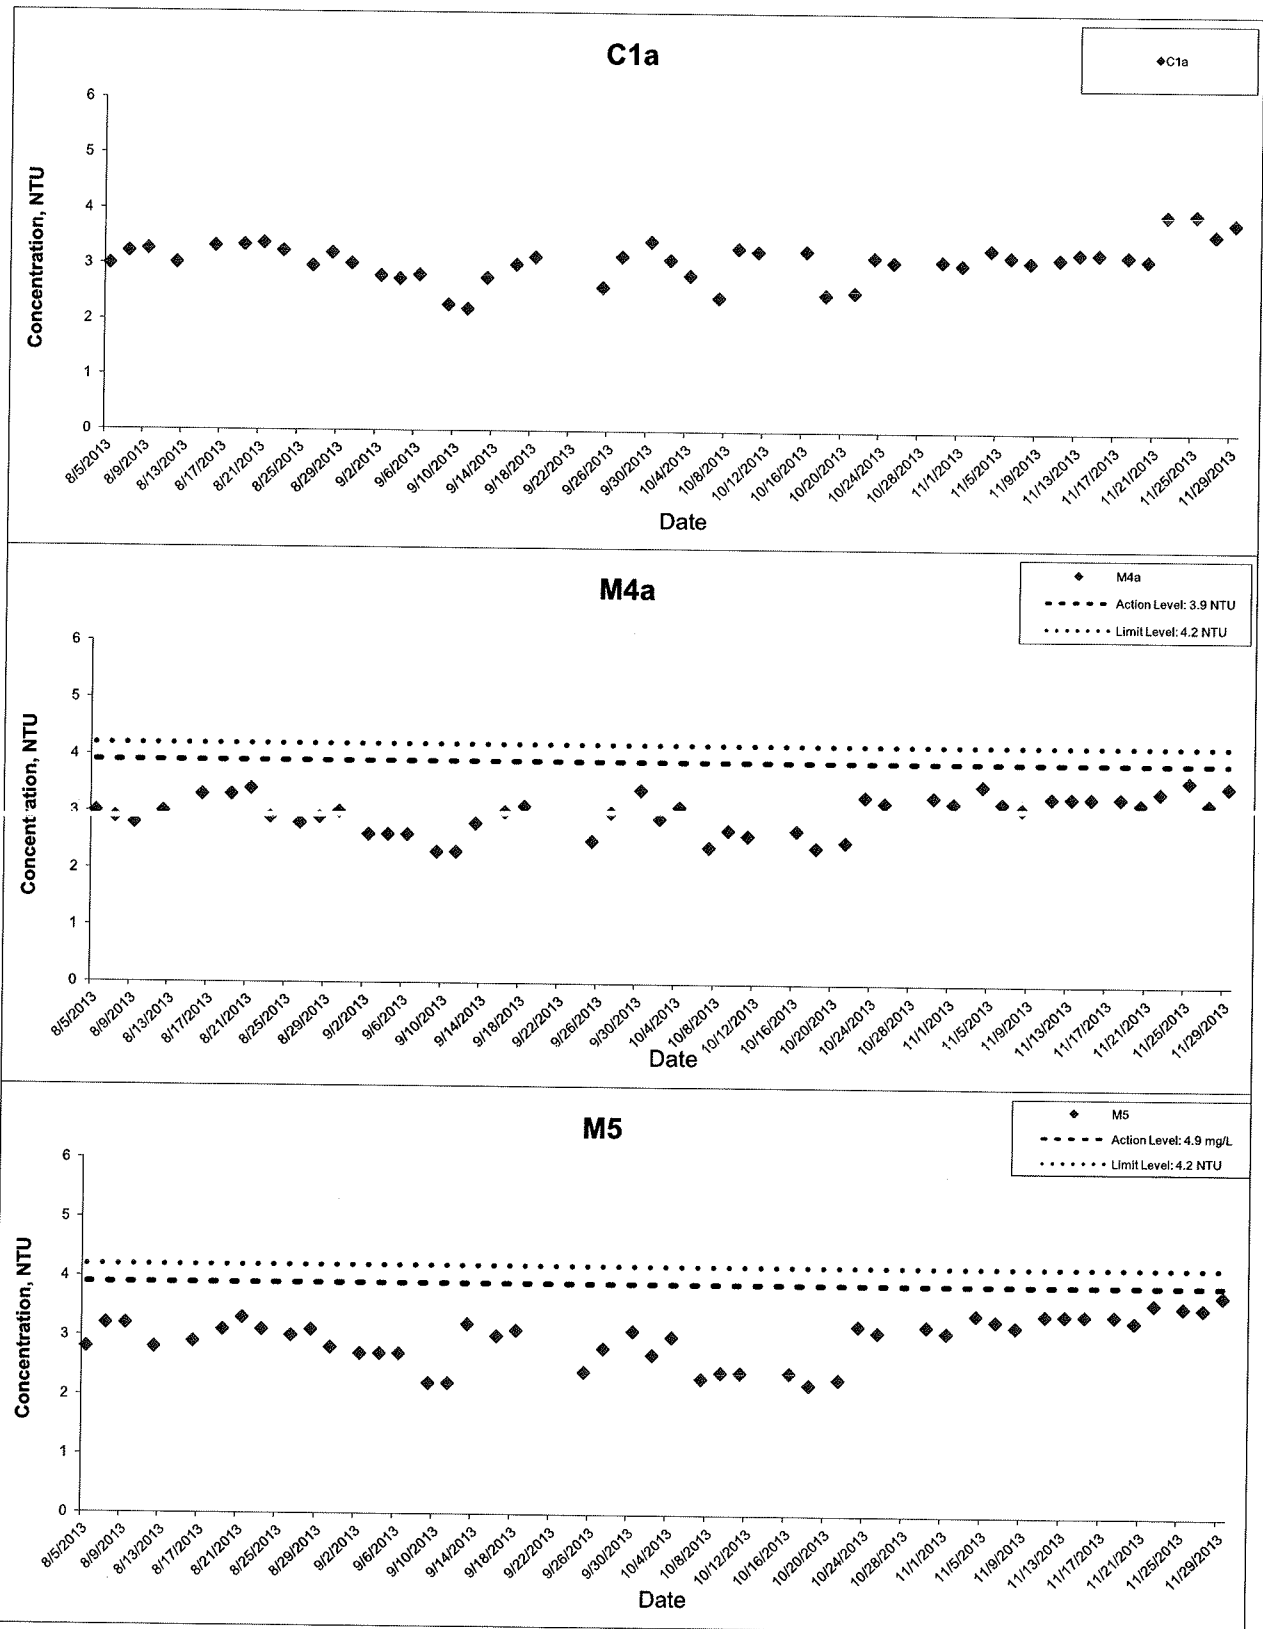

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

HONG KONG - ZHUHAI - MACAO BRIDGE

HONG KONG BOUNDARY CROSSING FACILITIES

- RECLAMATION WORKS

Graphical Presentation of Impact Water Quality  
Monitoring Results






Project No.: 60249820

Date: December 2013

Appendix C

## Suspended Solids at Mid-Ebb Tide

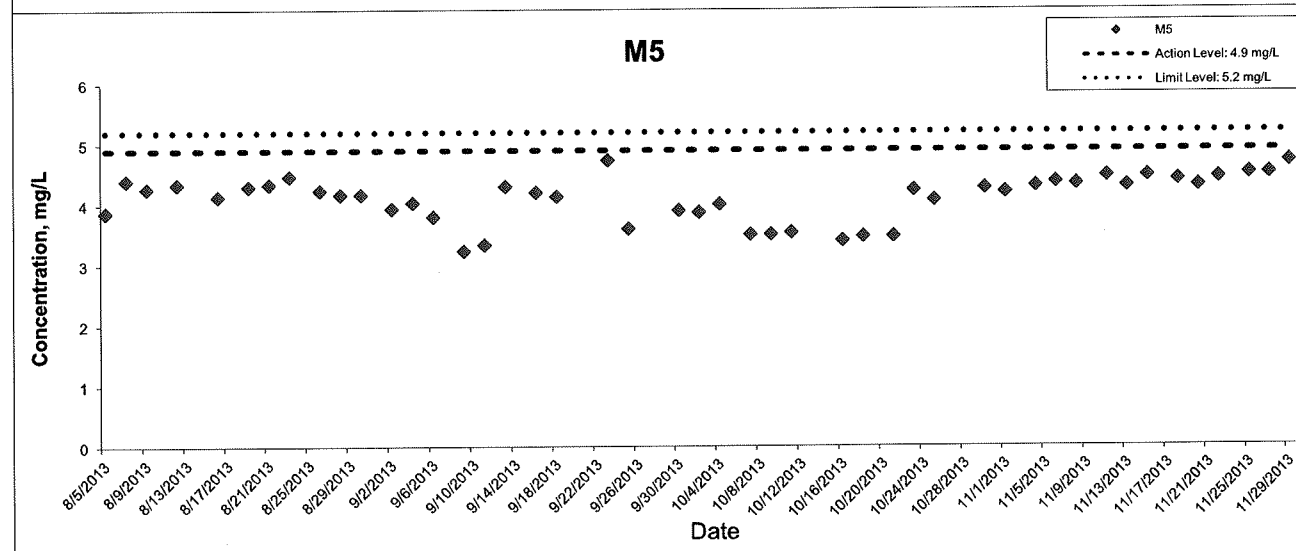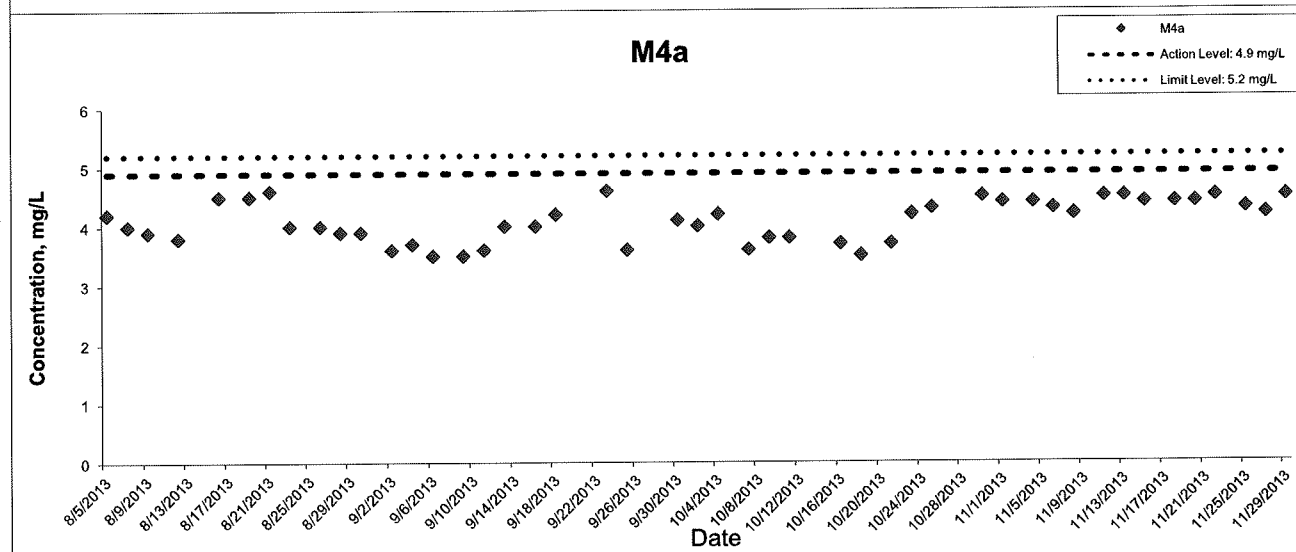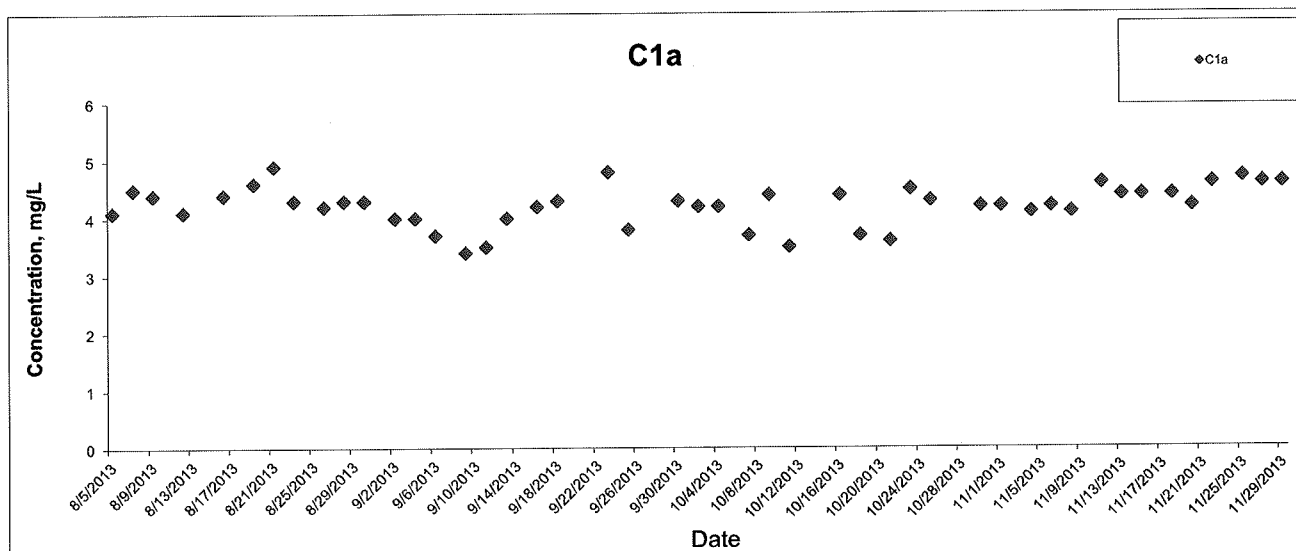

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

**HONG KONG - ZHUHAI - MACAO BRIDGE**

**HONG KONG BOUNDARY CROSSING FACILITIES**

**- RECLAMATION WORKS**

**Graphical Presentation of Impact Water Quality**

**Monitoring Results**

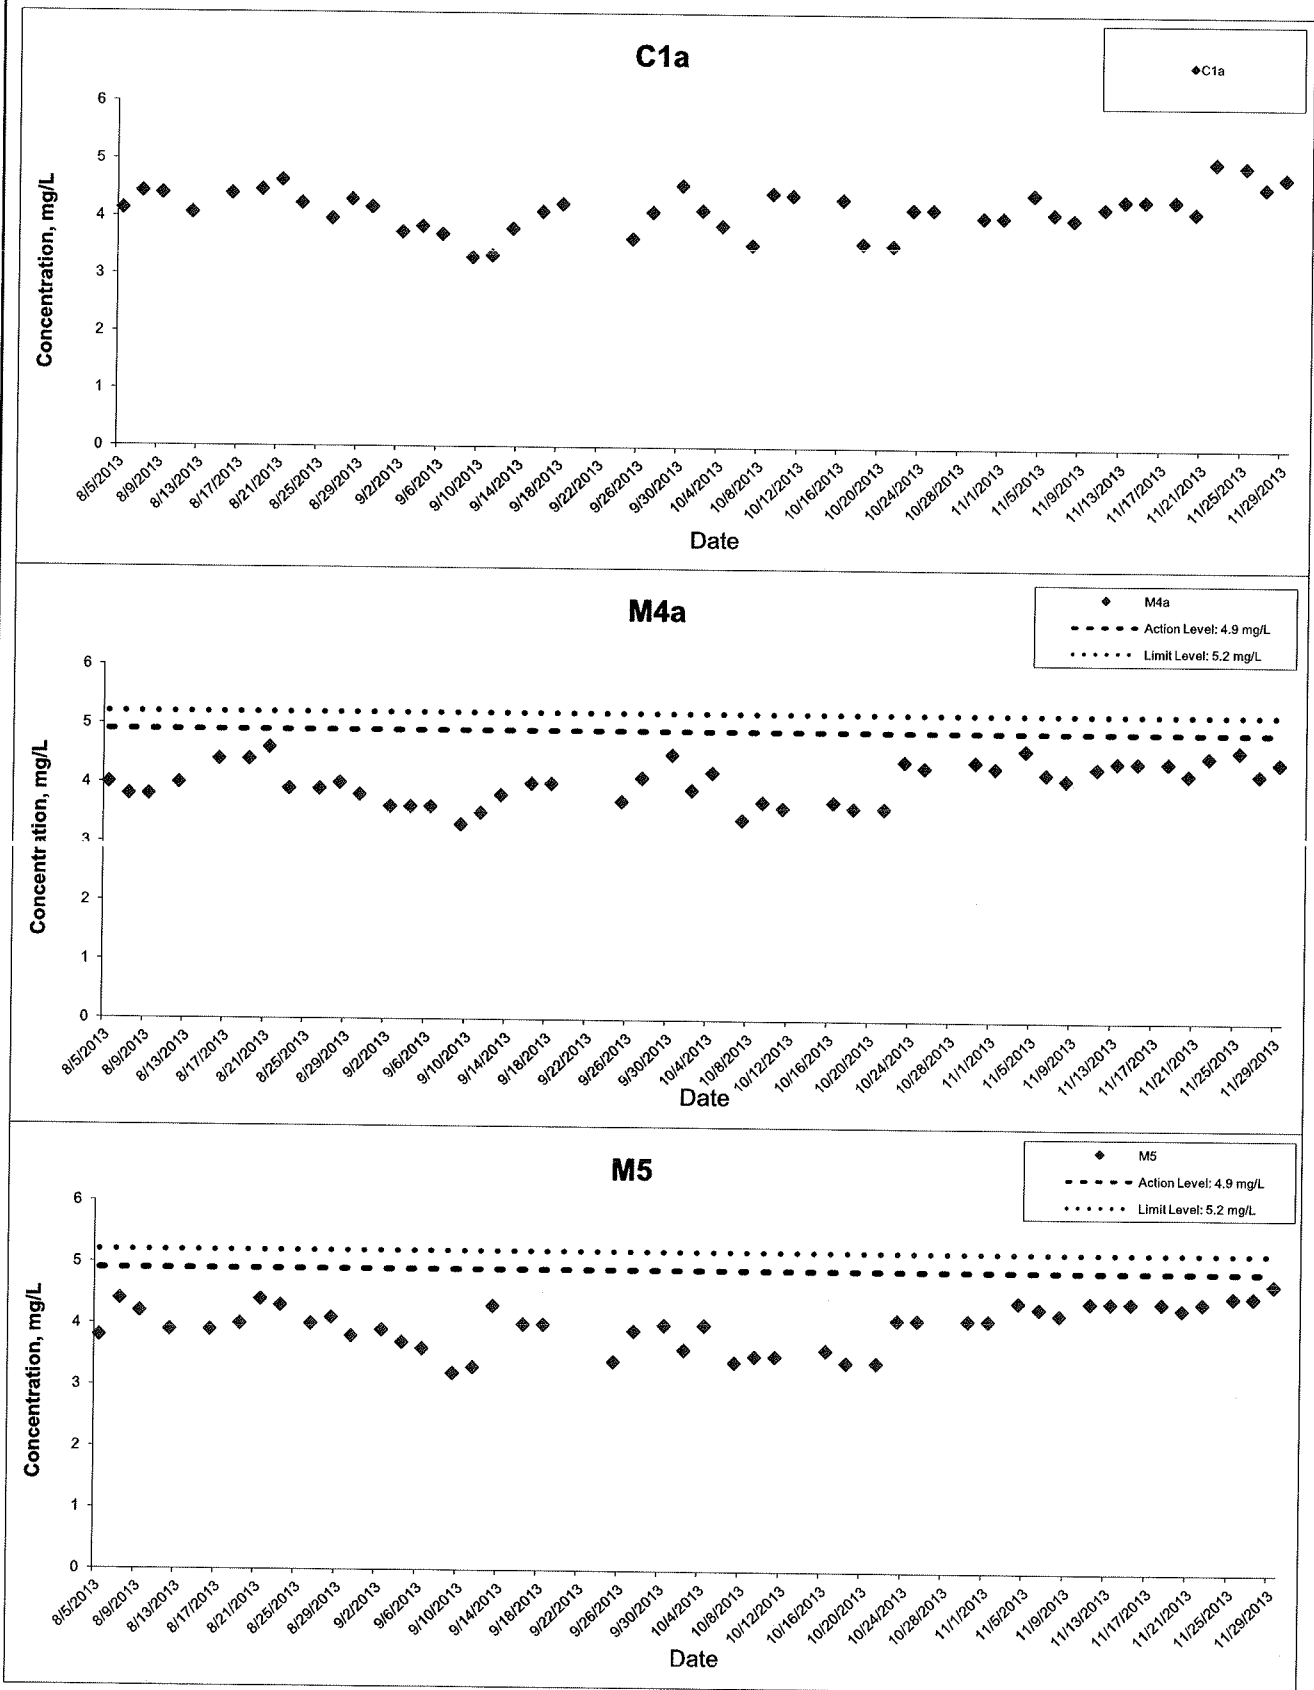
**Project No.: 60249820**

**Date: December 2013**



**Appendix C**

## Suspended Solids at Mid-Flood Tide



This drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent.

HONG KONG - ZHUHAI - MACAO BRIDGE  
 HONG KONG BOUNDARY CROSSING FACILITIES  
 - RECLAMATION WORKS

Graphical Presentation of Impact Water Quality  
 Monitoring Results



Project No.: 60249820

Date: December 2013

Appendix C

**APPENDIX D  
QA/QC REPORT**

### QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
01/11/2013	99.8	FC1a-S1	0.00	EC1a-S2	96.0
	98.6	EC1a-M1	8.70	EWM5-B2	102.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
04/11/2013	105.1	FC1a-S1	8.70	EC1a-S2	104.0
	94.9	EC1a-M1	0.00	EWM5-B2	102.1

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
06/11/2013	99.4	FC1a-S1	0.00	EC1a-S2	106.0
	95.0	EC1a-M1	8.70	EWM5-B2	100.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
08/11/2013	98.1	FC1a-S1	8.70	EC1a-S2	101.9
	92.4	EC1a-M1	0.00	EWM5-B2	106.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
11/11/2013	99.8	FC1a-S1	0.00	EC1a-S2	96.2
	98.4	EC1a-M1	8.00	EWM5-B2	94.2

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
13/11/2013	97.1	FC1a-S1	0.00	EC1a-S2	106.0
	104.3	EC1a-M1	8.70	EWM5-B2	102.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
15/11/2013	99.4	FC1a-S1	0.00	EC1a-S2	102.0
	106.2	EC1a-M1	8.70	EWM5-B2	95.7

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
18/11/2013	96.6	FC1a-S1	0.00	EC1a-S2	97.9
	103.6	EC1a-M1	8.70	EWM5-B2	100.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
20/11/2013	100.2	FC1a-S1	9.52	EC1a-S2	100.0
	93.4	EC1a-M1	0.00	EWM5-B2	98.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
22/11/2013	100.8	FC1a-S1	8.00	EC1a-S2	103.9
	96.8	EC1a-M1	0.00	EWM5-B2	104.1

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
25/11/2013	98.0	FC1a-S1	8.00	EC1a-S2	96.2
	92.6	EC1a-M1	0.00	EWM5-B2	102.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
27/11/2013	104.1	FC1a-S1	8.70	EC1a-S2	106.0
	104.9	EC1a-M1	0.00	EWM5-B2	102.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
29/11/2013	97.2	FC1a-S1	8.00	EC1a-S2	107.7
	97.9	EC1a-M1	0.00	EWM5-B2	106.3

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.