



東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED


8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong  
Tel : 2695 8318 E-mail : etl@ets-testconsult.com  
Fax : 2695 3944 Web site : www.ets-testconsult.com

## HKPFH Joint Venture

**Contract No.: CV/2013/06**  
**Handling of Surplus Public Fill**  
**(2014-2016)**

**TSEUNG KWAN O AREA 137 FILL BANK**  
**MONTHLY EM&A REPORT NO.3**  
**(MARCH 2014)**

Prepared by:

  
\_\_\_\_\_  
LAW, Sau Yee  
Senior Environmental Officer

Checked by:

  
\_\_\_\_\_  
LAU, Chi Leung  
Environmental Team Leader

Issue Date: 10 April 2014

Report No.: ENA40525



TABLE OF CONTENTS		Page
<b>EXECUTIVE SUMMARY</b>		
1.0	<b>INTRODUCTION</b>	1
2.0	<b>PROJECT INFORMATION</b>	
	2.1 Scope of the Project	1
	2.2 Site Description	1
	2.3 Work Programme	2
	2.4 Project Organization and Management Structure	2
	2.5 Contact Details of Key Personnel	2
3.0	<b>WORK PROGRESS IN THIS REPORTING MONTH</b>	2
4.0	<b>AIR QUALITY MONITORING</b>	
	4.1 Monitoring Requirement	2
	4.2 Monitoring Equipment	2
	4.3 Monitoring Parameters, Frequency and Duration	2
	4.4 Monitoring Locations and Schedule	3
	4.5 Monitoring Methodology	3
	4.6 Action and Limit levels	4
	4.7 Event-Action Plans	4
	4.8 Results and Observation	4
5.0	<b>NOISE MONITORING</b>	
	5.1 Monitoring Requirements	4
	5.2 Monitoring Equipment	4 – 5
	5.3 Monitoring Parameters, Duration and Frequency	5
	5.4 Monitoring Locations and Month	5
	5.5 Monitoring Procedures and Calibration Details	5
	5.6 Action and Limit levels	5
	5.7 Event-Action Plans	6
	5.8 Results and Observation	6
6.0	<b>MARINE WATER QUALITY MONITORING</b>	
	6.1 Monitoring Requirements	6
	6.2 Monitoring Locations	6
	6.3 Monitoring Parameters	6
	6.4 Monitoring Frequency	7
	6.5 Monitoring Methodology and Equipment Used	7 - 8
	6.6 Action and Limit Level	9
	6.7 Event and Action Plan	9
	6.8 Monitoring Duration and Month in this reporting month	9
	6.9 Marine Water Monitoring Results	9
7.0	<b>ENVIRONMENTAL AUDIT</b>	
	7.1 Weekly ET Site Inspections	10
	7.2 Review of Environmental Monitoring Procedures	10
	7.3 Assessment of Environmental Monitoring Results	10
	7.4 Advice on the Solid and Liquid Waste Management Status	11
8.0	<b>STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING</b>	11 – 12
9.0	<b>ENVIRONMENTAL NON-CONFORMANCE</b>	
	9.1 Summary of air quality, noise and marine water quality	12
	9.2 Summary of Environmental Complaints	12
	9.3 Summary of Notification of Summons and Prosecution	12
10.0	<b>IMPLEMENTATION STATUS</b>	
	10.1 Implementation Status of Environmental Mitigation Measures	12
	10.2 Implementation Status of Event and Action Plan	12
	10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling	12
11.0	<b>CONCLUSION AND RECOMMENDATIONS</b>	13 – 14
12.0	<b>FUTURE KEY ISSUE</b>	
	12.1 Work Programme for the Coming Month	14
	12.2 Key Issues for the Coming Month	14 – 15
	12.3 Monitoring Schedule for the Coming Month	15



## APPENDIX I

A	Organization Chart and Lines of Communication
B1	Calibration Certificates for Impact Air Quality Monitoring Equipment
B2	Impact Air Quality Monitoring Results
B3	Graphical Plots of Impact Air Quality Monitoring Data
C1	Calibration Certificates for Impact Noise Monitoring Equipment
C2	Impact Noise Monitoring Results
C3	Graphical Plots of Impact Noise Monitoring Data
D1	Calibration Certificates for Impact Marine Water Quality Monitoring Equipment
D2	Impact Marine Water Quality Monitoring Results
D3	Graphical Plots of Impact Marine Water Quality Monitoring Data
E	Weather Condition
F	Event-Action Plans
G	Work Programme
H	Weekly ET's Site Inspection Record
I	Implementation Schedule of Mitigation Measures
J	Site General Layout Plan
K	Monitoring Schedule for the Coming Month
L	Complaint Log

## APPENDIX I

### FIGURES

Figure 1	Locations of Water Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank
Figure 2	Location of Noise Quality Monitoring Station – Tseung Kwan O Area 137 Fill Bank
Figure 3	Locations of Air Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank

## APPENDIX II

Marine Water Quality Monitoring Report for Contract No. HY/2010/02 Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing Facilities – Reclamation Works

## TABLES

2.1	Contact Details of Key Personnel
4.1	Air Quality Monitoring Equipment
4.2	Monitoring parameters, duration and frequency of air quality monitoring
4.3	Air Quality Monitoring Locations
4.4	Action and Limit levels for 24-hr TSP and 1-hr TSP
5.1	Noise Monitoring Equipment
5.2	Duration, Frequency and Parameters of noise monitoring
5.3	Noise Monitoring Location
5.4	Action and Limit levels for noise monitoring
6.1	Locations of Marine Water Monitoring Stations
6.2	Marine Water Quality Monitoring Parameters
6.3	Monitoring frequency of the marine water
6.4	Summary of testing procedures
6.5	Details of Marine Water Quality Monitoring Equipment (In-site measurement)
6.6	Water Quality Action and Limit Levels
6.7	Time Schedule of Impact Marine Water Quality Monitoring
6.8	Summary of Impact Marine Water Quality Exceedances in this reporting month
7.1	Key Findings of Weekly ET Site Audits in this reporting month
7.2	Actual amounts of Waste generated in this reporting month
8.1	Summary of environmental licensing and permit status
10.1	Summary of Environmental Complaints and Prosecutions



## **EXECUTIVE SUMMARY**

This monthly Environmental Monitoring and Audit (EM&A) report No.3 was prepared by ETS-Testconsult Ltd (ET) for the “Contract No: CV/2013/06 – Handling of Surplus Public Fill (2014-2016) – Tseung Kwan O (TKO) Area 137 Fill Bank” (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at TKO Area 137 in March 2014.

### **Site Activities**

As informed by the Contractor, the site activities in this reporting month were as below:

- *Internal public fill transferring and stockpiling;*
- *Loading of public fill by excavator and unload into vessels;*
- *Erection of Engineer Principal Site Office;*
- *Erection of new CCTV tower.*

### **Environmental Monitoring Progress**

The summary of the monitoring activities in this monitoring month is listed below:

- *Noise Monitoring (Day-time): 1 Occasion at 1 designated location*
- *24-hour TSP Monitoring: 5 Occasions at 2 designated locations*
- *1-hour TSP Monitoring: 16 Occasions at 2 designated locations*
- *Marine Water Quality Monitoring: 13 Occasions at 2 designated locations*
- *Weekly-site inspection: 4 Occasions*

### **Noise Monitoring**

No exceedance of Action and Limit levels for noise monitoring was recorded in the reporting month.

### **Air Monitoring**

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting month.

### **Marine Water Quality Monitoring**

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded in this reporting month.

### **Weekly Site Inspections**

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting month. The major findings observed during site inspections are presented in the Section 7.0.

### **Environmental Complaints, Notification of summons and successful prosecutions**

No complaint, notification of summons or successful prosecutions with respect to environmental issues was received in this reporting month.

### **Future Key Issues**

Based on site inspections and forecast of engineering works in coming month, key issues to be considered are as follows:

- *Noise and air quality impact due to site works;*
- *Maintain wheel washing facilities properly;*
- *Maintain all drainage and desilting facilities properly;*
- *Use and maintain silt curtain properly;*
- *Clean up the fill material on concrete pavement along the BHA frequently;*
- *Sufficient drip trays for all oil drums / chemical containers;*
- *Implement all necessary preventive measures to avoid oil leakage. In the event an oil leakage happens, the Contractor should properly remove the leaked oil and handle the contaminated soil and all materials using for this cleaning works as chemical waste;*
- *Maintain good site practice and waste management to minimize environmental impacts at the site; and*
- *Follow-up improvements on waste management issues.*



## 1.0 INTRODUCTION

HKPFH Joint Venture (HKPFH-JV) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the “Contract No: CV/2013/06 – Handling of Surplus Public Fill (2014-2016) – Tseung Kwan O (TKO) Area 137 Fill Bank” (The Project).

In accordance with the Environmental Permit (No.: EP-134/2002/K) (the EP), an EM&A programme should be implemented in accordance with the procedures and requirements in the EM&A Manual of the approved EIA report (Registration No. AEIAR-060/2002). The EM&A programme for this study as stated in Section 2.3.1 of the EM&A Manual covers the following environmental aspects during the establishment, operation and removal phases of the Fill Bank at Tseung Kwan O Area 137:

- *Fugitive Dust;*
- *Noise generation from onsite activities;*
- *Water Quality; and*
- *Landscape and Visual.*

The EM&A programme requires environmental monitoring for air quality, noise and water quality and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- *All monitoring parameters;*
- *Monitoring schedules for the reporting month and forthcoming months;*
- *Action and Limit levels for all environmental parameters;*
- *Event/Action Plans;*
- *Environmental mitigation measures, as recommended in the Project EIA study final report; and*
- *Environmental requirements in contract documents.*

Baseline monitoring was completed in August and September 2002 by Materialab. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 in March 2014.

## 2.0 PROJECT INFORMATION

### 2.1 Scope of the Project

The scale and scope of the Project as stated in the EP include:

- Site clearance;
- Construction of a temporary storm water system;
- Stockpiling of 6 million m<sup>3</sup> of public fill;
- Setting up two barging points: one at the TKO Basin and one at the Construction and Demolition Material Sorting Facility (C&DMSF) for transporting the stockpiled public fill by barges;
- Setting up a temporary barging point at the existing Explosive Off-loading Barging Point located in the south-eastern part of Area 137 for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge;
- Construction and operation of a Construction and Demolition Material Sorting Facility (C&DMSF);
- Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin; and
- Remove the temporary fill bank.

### 2.2 Site Description

TKO Area 137 Fill Bank is located at the southern end of Wan Po Road. In the vicinity of the site are other industrial uses such as SENT landfill, TKO Industrial Estate, etc. Both Island Resort and Fullview Garden are also situated at more than 1.8km from the site. Other existing ASRs and NSRs, including resident developments and schools, are located at a further distance away from TKO Area 137.



### 2.3 Work Programme

Details of work programme are shown in Appendix I G.

### 2.4 Project Organization and Management Structure

The project organization chart is shown in Appendix I A.

### 2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Mr. P C Mok Mr. K C Wong Mr. C T Chock Mr. Y F Kwong	Engineer's Representative	2762 5514	2714 0113
IEC (ENVIRON)	Mr Tony Cheng	IEC	3465 2888	3465 2899
Contractor (HKPFH-JV)	Mr. K W Li	Project Manager	9750 6438	2744 6937
ET (ETL)	Mr C. L. Lau	ET Leader	2946 7791	2695 3944

### 3.0 WORK PROGRESS IN THIS REPORTING MONTH

As informed by the Contractor, the activities in the reporting month include:

- Internal public fill transferring and stockpiling;
- Loading of public fill by excavator and unload into vessels;
- Erection of Engineer Principal Site Office;
- Erection of new CCTV tower.

### 4.0 AIR QUALITY MONITORING

#### 4.1 Monitoring Requirement

TSP levels were monitored in the reporting month in accordance with the EM&A Manual. Table 4.4 shows the Action and Limit Levels for the environmental monitoring works.

#### 4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificates for the HVS and calibrator are attached in Appendix I B1.

Table 4.1 Air Quality Monitoring Equipment

Equipment	Model and Make
HVS	Greasby GMWS2310
Calibrator	Tisch TE-5025A

#### 4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequency of air quality monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr	Once every six days
1-hr TSP	1 hr	Three times per day every six days



#### 4.4 Monitoring Locations

Table 4.3 tabulates the air quality monitoring locations of this project.

Table 4.3 Air quality monitoring locations

Monitoring station	Location
TKO-A1	Site Egress
TKO-A2a	CREO

#### 4.5 Monitoring Methodology

##### **Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)**

##### Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

##### Installation

The installation of HVS refers to the requirement stated in EM&A Manual.

##### Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 0.6m<sup>3</sup>/min and 1.7m<sup>3</sup>/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The flow rate was indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (GA-55) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling month of 1 hour or 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recorded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of 25°C ± 3°C and the relative humidity (RH) <50% ±5%.
- All measurement procedures in Section 2.3 of the EM&A Manual were followed during the reporting month.

##### Maintenance & Calibration

- HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

##### **Wind Data Monitoring**

Wind data (wind speed and wind direction) were directly extracted from Tseung Kwan O Station of Hong Kong Observatory. All wind data during this reporting month are shown in Appendix I E.



#### 4.6 Action and Limit Levels

Table 4.4 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Table 4.4 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring Location	24-hr TSP ( $\mu\text{g}/\text{m}^3$ )		1-hr TSP ( $\mu\text{g}/\text{m}^3$ )	
	Action Level	Limit Level	Action Level	Limit Level
TKO-A1	210	260	376	500
TKO-A2a *	210	260	376	500

Remark (\*): Since dust monitoring stations TKO-A2 and TKO-A2a are located close to the major dust emission sources and also close to the same sensitive receptor and no significant difference between them on the prevailing meteorological conditions, the baseline data from TKO-A2 (August and September 2002 by MateriaLab) can also be valid in the case of TKO-A2a.

#### 4.7 Event-Action Plans

Please refer to Appendix I F for details.

#### 4.8 Results and Observation

##### 4.8.1 1-hour and 24-hour TSP Monitoring results

Monitoring data of both 1-hour and 24-hour TSP monitoring carried out in this reporting month are summarized in Appendix I B2. Graphical presentation of 1-hour and 24-hour TSP monitoring results for the reporting month is shown in Appendix I B3. Wind data included wind speed and wind direction was extracted from Tseung Kwan O Station of Hong Kong Observatory during this reporting month and is presented in Appendix I E.

No exceedance of Action and Limit Level of 1-hr TSP and 24-hour TSP monitoring results was recorded during the reporting month.

##### 4.8.2 Observation

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of the mist spraying systems at the CEDD Combined Reception Office and the site egress area, wheel washing facilities, road dampening by water bowsers and automatic water sprinklers on the main haul roads. Furthermore, hydroseeded slopes on the stockpiling areas was maintained properly in order to prevent dust generation from wind erosion of the exposed surfaces. Other dust sources near TKO Area 137 also included operation of the temporary CWSF and dumping activities at the SENT Landfill.

#### 5.0 Noise Monitoring

##### 5.1 Monitoring Requirements

Noise monitoring was conducted at 1 monitoring station as specified in the approved EM&A Monitoring Proposal for good site practice. The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting month are presented in this section.

##### 5.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level ( $L_{eq}$ ) and percentile sound pressure level ( $L_x$ ). It complies with International Electro Technical Commission Publications 651:1979 (Type1) and 804:1985 (Type1), and speed in m/s was used to monitor the wind speed.

Table 5.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix I C1.





Table 5.1 Noise Monitoring Equipment

Equipment	Model
Sound Level Meter	Rion NL-31 / Rion NL-52
Sound Level Calibrator	Rion NC-73 / Castle GA607

### 5.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 5.2.

Table 5.2 Duration, Frequencies and Parameters of Noise Monitoring

Time month	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	$L_{eq}$ , $L_{10}$ , $L_{90}$	Once per month

### 5.4 Monitoring Locations

One Noise monitoring was conducted at the noise monitoring location, TKO-N1 as shown in Figure 2 during the reporting month. Table 5.3 describes the location of the monitoring station.

Table 5.3 Noise Monitoring Location

Monitoring station	Location	Type of Measurement
TKO-N1	Outside site Egress along Wan Po Road	Free Field

### 5.5 Monitoring Procedures and Calibration Details

#### Operation/Analysis Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - Frequency weighting: A
  - Time weighting : Fast
  - Time measurement : 30 mins
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring month, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

#### Maintenance and Calibration

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

### 5.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 5.4.

Table 5.4 Action and Limit Levels for noise monitoring

Time Month	Time Month	Action	Limit
Normal hours	0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)



## 5.7 Event-Action Plans

Please refer to the Appendix I F for details.

## 5.8 Results and Observation

### 5.8.1 Results

Only Day-time noise monitoring was carried out at monitoring station TKO-N1 in this reporting month. The detail of the noise monitoring is provided in Appendix I C2. Graphical presentation of the monitoring result for the reporting month is shown in Appendix I C3.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedances were recorded. Besides, no exceedances in Limit Level were recorded according to the result from Day-time monitoring.

### 5.8.2 Observation

The major noise source during the monitoring event was the dump truck traffic. Operation of the Fill Bank was from 08:00 to 21:00 from Monday to Sunday in the reporting month. Whereas the operation hours for barge activities in the TKO Basin was from 08:00 to 21:00. The monitoring result complied with the noise limit of 75dB(A).

## 6.0 MARINE WATER QUALITY MONITORING

### 6.1 Monitoring Requirements

In accordance with the EM&A Manual, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at Control Station, C1 and Monitoring Station, M4.

### 6.2 Monitoring Locations

For the Reclamation Project, there were 4 Designated Monitoring Stations and 2 Designated Control Stations specified in the EM&A Manual. Upon the completion of the monitoring programme under Stage 2 reclamation works, the ET started monitoring events at the impact station M4 and the control station C1 from 18 May 2004 onwards. Figure 1 shows the location of the marine water quality monitoring stations. Table 6.1 describes the locations of the monitoring stations in the reporting month.

Table 6.1 Locations of Marine Water Monitoring Stations

Station Description	Code	HK Metric Grid E	HK Metric Grid N
Control Station (Ebb tide)	TKO-C1	844 740.208	815 371.502
Monitoring Station, Tung Lung Chau Fish Culture Zone	TKO-M4	847 741.029	812 977.878

### 6.3 Monitoring Parameters

Monitoring of the marine water quality parameters are listed in Table 6.2.

Table 6.2 Marine Water Quality Monitoring Parameters

In-situ measurement	Laboratory analysis
Depth (m)	Suspended solids (mg/L)
Temperature (°C)	
Dissolved Oxygen (mg/L and % saturation)	
Turbidity (NTU)	
Salinity (ppt)	



## 6.4 Monitoring Frequency

The monitoring frequency of the marine water monitoring is summarized in Table 6.3.

Table 6.3 Monitoring frequency of the marine water

Parameter	Frequency	No. of Location	No. of Depths
Temperature	3 days/week, 2 tides/day	2 (TKO-C1 and TKO-M4)	3 (Surface, mid-depth & bottom)
Salinity			
DO			
Turbidity			
Suspended solids			

## 6.5 Monitoring Methodology and Equipment Used

### For Location of the monitoring stations

#### **Global Positioning System (GPS)**

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

### For Water Depth measurement

#### **Echo Sounder**

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

### For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.

#### **Dissolved Oxygen, Salinity and Temperature Measuring Equipment**

A portable, weatherproof dissolved oxygen & salinity measuring instrument, which complete with cable, sensor and DC power source (e.g. YSI 85 or equivalent) was used for measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200 % saturation;
- a salinity in range 0-40 ppt; and
- a temperature of 0-45 degree Celsius

A membrane electrode with automatic temperature compensation complete with a cable was installed.

#### **Turbidity Measurement Instrument**

A portable and weatherproof turbidity meter (HACH model 2100Q) was used during impact monitoring. It has a photoelectric sensor capable of measuring turbidity between 0-1000 NTU. Response of the sensor was checked with certified standard Turbidity solutions before the start of measurement.

### For Water Sampling and Sample Analysis

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. If the water depth is less than 6 m, the mid-depth station shall be omitted and if the water depth is below 3 m, only the mid depth station shall be monitored.

#### **Water Sampler**

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.



### Water Container

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labelled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 6.4.

Table 6.4 Summary of testing procedures

Laboratory Analysis	Testing Procedure	Detection Limit
Total suspended solids	In house method based on APHA 19 <sup>th</sup> ed 2540D	1.0 mg/L

### In-situ measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before the start of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO, DOS and Salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required.

Table 6.5 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix I D1.

Table 6.5 Details of Marine Water Quality Monitoring Equipment (In-site measurement)

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	Garmin eTrex 10	----	----	ET/EW/005/04
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI Pro2030	29/01/14	28/04/14	ET/EW/008/004 *
Turbidity	HACH Model 2100Q Turbid Meter	07/01/14	06/04/14	ET/0505/010 *
Water Depth	Speedtech SM-5	----	----	ET/EW/002/06

Remark: (\*) indicates the instrument should be calibrated on use.



### 6.6 Action and Limit Level

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.

Table 6.6 Water Quality Action and Limit Levels

Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface &amp; Middle</u> <5.45 mg/L (5%-ile of baseline data) <u>Bottom</u> <4.72 mg/L (5%-ile of baseline data)	<u>Surface &amp; Middle</u> <5.10 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth-averaged)	>6.74 mg/L (95%-ile of baseline data) or >120% of the upstream control station's SS at the same tide on the same day	>7.67 mg/L (99%-ile of baseline data) or >130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth-averaged)	>4.28 NTU (95%-ile of baseline data) or >120% of the upstream control station's turbidity at the same tide on the same day	>4.58 NTU (99%-ile of baseline data) or >130% of the upstream control station's turbidity at the same tide on the same day

### 6.7 Event and Action Plan

Please refer to the Appendix I F for details.

### 6.8 Monitoring Duration and Month in this reporting month

Below is the time schedule for the marine water quality monitoring events that were conducted in this reporting month:

Table 6.7 Time Schedule of Impact Marine Water Quality Monitoring

March 2014						
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
						1
2	3	4	5	6	7	8
	▼		▼		▼	
9	10	11	12	13	14	15
	▼		▼		▼	
16	17	18	19	20	21	22
	▼		▼		▼	
23	24	25	26	27	28	29
	▼		▼		▼	
30	31					
	▼					

Remarks: ( ▼ ) = Marine water quality monitoring carried out by ET.

The daily marine water quality monitoring duration are detailed in Appendix I D2.

### 6.9 Marine Water Quality Monitoring Results

The impact water quality measurement results are detailed in Appendix I D2. Appendix I D3 presents the water quality monitoring data and graphical presentations of monitoring results respectively.

The summary of marine water quality exceedances is shown in Table 6.8.

Table 6.8 Summary of Impact Marine Water Quality Exceedances in this reporting month

Station	Exceedance Level	DO		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
TKO-C1	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0
TKO-M4	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0



According to the summary of marine water monitoring results, no exceedance of Action and limit levels was recorded for this reporting month.

## 7.0 ENVIRONMENTAL AUDIT

### 7.1 Weekly ET Site Inspections

Weekly ET site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting month, four weekly site inspections were conducted (05, 12, 19 and 26 March 2014). Table 7.1 presents the key findings of weekly ET site audit in this reporting month.

Table 7.1 Key Findings of Weekly ET Site Audits in this reporting month

Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor during the ET weekly site audit	Rectification Status by ET
05 March 2014	No skirt curtain was provided for the generator near tipping hall No.2. (Previous item)	To provide suitable skirt curtain for all generator.	New skirt curtain was provided for the generator near tipping hall No.2.	Closed
	The position of silt curtain near CEDD site office was found shifted. (New item)	To re-located the shifted silt curtain properly.	---	Follow-up
	The floating booms of silt curtain near the tipping hall No.1 was found damaged. (New item)	To repair the damaged silt curtain properly.	---	Follow-up
12 March 2014	The position of silt curtain near CEDD site office was found shifted. (Previous item)	To re-located the shifted silt curtain properly.	---	Follow-up
	The floating booms of silt curtain near the tipping hall No.1 was found damaged. (Previous item)	To repair the damaged silt curtain properly.	---	Follow-up
19 March 2014	The position of silt curtain near CEDD site office was found shifted. (Previous item)	To re-located the shifted silt curtain properly.	---	Follow-up
	The floating booms of silt curtain near the tipping hall No.1 was found damaged. (Previous item)	To repair the damaged silt curtain properly.	---	Follow-up
	Oil stain was noted from a generator at CREO. (New item)	To clean up the oil stain and treat the contaminated material as chemical waste, and check / repair the generator to avoid oil leakage.	---	Follow-up
	The enclosure of tipping hall No.3 was found damaged. (New item)	To repair the damaged parts of tipping hall properly.	---	Follow-up
26 March 2014	The position of silt curtain near CEDD site office was found shifted. (Previous item)	To re-located the shifted silt curtain properly.	---	Follow-up
	The floating booms of silt curtain near the tipping hall No.1 was found damaged. (Previous item)	To repair the damaged silt curtain properly.	The floating booms of silt curtain near the tipping hall No.1 were repaired.	Closed
	Oil stain was noted from a generator at CREO. (Previous item)	To clean up the oil stain and treat the contaminated material as chemical waste, and check / repair the generator to avoid oil leakage.	Oil stain from a generator at CREO was cleaned up.	Closed



Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor during the ET weekly site audit	Rectification Status by ET
26 March 2014	The enclosure of tipping hall No.3 was found damaged. (Previous item)	To repair the damaged parts of tipping hall properly.	The enclosure of tipping hall No.3 was repaired.	Closed
	Mud and silt were found accumulated inside the drainage near the entrance of sorting facilities.	To clear the accumulated mud and silt inside the drainage.	---	Follow-up

## 7.2 Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. The observations for the monitoring works were recorded and summarized as follows:

### Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.

### Noise Monitoring

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.

### Water Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.

## 7.3 Assessment of Environmental Monitoring Results

All monitoring results were audited against the Action and Limit levels and any exceedance would be validated.

No exceedance was recorded in water quality, air quality and noise monitoring in this month.

The monitoring results in this reporting month were comparable with those of baseline month. Detailed discussions were given in Section 4, 5 and 6 of this Report.

## 7.4 Advice on the Solid and Liquid Waste Management Status

The Contractor usually disposed of non-inert waste, including general refuse and materials segregated from the existing stockpiles, to SENT landfill. Table 7.2 summarizes data on offsite waste disposal in this reporting month.

Table 7.2 Actual amounts of Waste generated in this reporting month

Waste Type	Actual Amount	Disposal Locations
Public Fill (m <sup>3</sup> )	0	TKO 137 Fill Bank
C&D Waste (general refuse) (kg)	201660	SENT Landfill
Chemical Waste (kg/L)	0	Collected by licensed collector

The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.



Concrete bunding has erected outside the CEDD combined reception office and near the automatic wheel washing facilities for storing generator sets and oil drums. The drain outlet of all the bunded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal were properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank, DP3 and DP4 and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.

All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

## 8.0 Status of Environmental Licensing and Permitting

All permits/licenses valid in this reporting month are summarized in Table 8.1.

Table 8.1 Summary of environmental licensing and permit status

Description	Permit No.	Valid Month		Section
		From	To	
Amended Environmental Permit	EP-134/2002/K	04/02/13	---	<ul style="list-style-type: none"> <li>▪ Site clearance</li> <li>▪ Construction of a temporary storm water system</li> <li>▪ Stockpiling of 6 million m3 of public fill</li> <li>▪ Setting up two barging points for transporting the stockpiled public fill by barges</li> <li>▪ Setting up a temporary barging point at the existing Explosive Off-loading Barging Point for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge</li> <li>▪ Construction of operation of a construction and Demolition Material Sorting Facility (C&amp;DMSF)</li> <li>▪ Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin</li> <li>▪ Remove the temporary fill bank</li> </ul>
Chemical Waste Producer	5213-839-H3552-01	21/01/14	---	Spent Lubricating Oil and Spent Battery
Marine Dumping Permit	EP/MD/14-119	21/01/14	31/03/14	Approval for dumping 2,800,000 tons (approximately equal to 1,555,555 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan
Billing Account for Waste Disposal	7018998	---	---	---
Effluent Discharge License	Application in progress			





## 9.0 ENVIRONMENTAL NON-CONFORMANCE

### 9.1 Summary of air quality, noise and marine water quality

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

### 9.2 Summary of Environmental Complaints

No complaint was received in this reporting month.

### 9.3 Summary of Notification of Summons and successful Prosecution

There was no notification of summons and successful prosecution respect to environmental issues registered in this reporting month.

## 10.0 IMPLEMENTATION STATUS

### 10.1 Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix I I. Most of the necessary mitigation measures were implemented properly. Any deficiencies were noted in the remarks of the schedule.

### 10.2 Implementation Status of Event and Action Plan

Since no exceedance of Action and Limit level of air, noise and marine water monitoring results was recorded for this reporting month, no further action was required.

### 10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

No complaint, notification of summon and successful prosecution was received in this reporting month. A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 10.1 and further details of the complaint could be found in the Complaint Log (Appendix I L).

Table 10.1 Summary of Environmental Complaints and Prosecutions

<i>Complaints logged</i>		<i>Summons served</i>		<i>Successful prosecution received</i>	
<i>March 2014</i>	<i>Cumulative</i>	<i>March 2014</i>	<i>Cumulative</i>	<i>March 2014</i>	<i>Cumulative</i>
0	0	0	0	0	0

## 11.0 CONCLUSIONS AND RECOMMENDATIONS

### Conclusions

Impact monitoring of air quality, noise and water quality were carried out at designated locations in accordance with the EM&A Manual in this reporting month.

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.



According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

No complaint, prosecutions and notifications of summons were received in this reporting month.

According to the ET weekly site inspections carried out in this reporting month, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

### **Recommendations**

According to the environmental site inspections performed in the reporting month, the following recommendations were provided:

#### ***Air Quality***

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowers;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the site activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

#### ***Noise***

- Conduct noisy activities at a farther location from the NSRs.

#### ***Water Quality***

- Maintain the drainage system, including the trapezoidal channels, permanent desilting chambers, regularly;
- Operate and maintain the silt curtains regularly;
- Operate the cleaning vessel within the TKO Basin regularly;
- Clean up the fill material on the concrete pavement at BHA frequently; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

#### ***Landscape and Visual***

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeded slopes in accordance with the Landscape Plan.

#### ***Chemical and Waste Management***

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain mesh screen on top of the additional drainage to avoid improper dumping of rubbish;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.



## 12.0 FUTURE KEY ISSUES

### 12.1 Work Programme for the Coming Month

As informed by the Contractor, the activities to be conducted by them in the next month included:

- Unloading fill material at tipping hall;
- Transferring fill material to stockpile area and BCF;
- Construction of Contractor's and Engineer's site office;
- Unloading fill material from derrick barge with mechanical claw; and
- Construction of CCTV tower.

### 12.2 Key Issues for the Coming Month

**Key issues to be considered in the coming month include:**

- Chemical and waste management;
- Treatment of runoff and wastewater prior to discharge;
- Dust generated from loading and unloading activities; and
- Dust generated from dump trucks traffic.

**Mitigation measures to be required in the coming month:**

#### Air Quality Impact

- To provide adequate water spraying on haul roads and working platform;
- To operate and maintain automatic wheel washing facilities properly;
- To dampen the fill material prior to unloading or movement;
- To provide road sweeping on haul road near site egress and public roads outside site egress;
- To ensure implementation of the dust mitigation measures for the site activities;
- To maintain proper operation of the mist spraying system;
- To provide proper maintenance for vehicles and machines on site; and
- To investigate any other dust sources around the air sensitive receivers

#### Noise

- To switch off equipment if not in use;
- To operate silent equipment;
- To identify the noise sources inside and outside of the site;
- To follow up any exceedance caused by the Fill Bank operation; and
- To re-schedule the work activities in the event of valid noise exceedance.

#### Water Quality Impact

- To maintain the drainage system in the Fill Bank;
- To ensure the cleanliness of oil interceptor bypass tanks and all the drainage channels;
- To maintain the existing silt trap to ensure good efficiency of wheel wash facilities;
- To repair, inspect and maintain the silt curtains regularly;
- To provide covers for the drip trays to avoid stagnant water pond due to rainfall;
- To provide proper treatment for oily water discharged from the area around air monitoring station TKO-A1;
- To deploy a cleaning vessel to remove floating rubbish in the TKO Basin;
- To clean up the concrete paved area at Portion I every night to avoid fill materials from being washed into the sea; and
- To avoid any stagnant water or provide insecticide to avoid mosquito breeding in the Fill Bank.

#### Chemical and Waste Management

- To remove waste from the site regularly;
- To properly store and handle chemical wastes on site;
- To implement trip ticket system for all the imported public fill and general refuse disposal;
- To provide and manage sufficiently sized drip trays for diesel drums or chemical containers;
- To remove existing unwanted material in the stockpiles and avoid improper disposal at the Fill Bank through inspection of imported truckloads;
- To maintain proper housekeeping at the workshop area;
- To remove the oil stains in the event of leakage and handle all materials using for this cleaning works as chemical waste;



- To maintain mesh screen on top of the additional drainage, DP3 opening to avoid improper dumping of rubbish into this channel; and
- To identify C&D material by packaging, labeling, storage, transportation and disposal in accordance with statutory regulations.

### **12.3 Monitoring Schedule for the Coming Month**

The proposed EM&A program of the coming month is attached in Appendix I M.


- END OF REPORT -

## Appendix I

### A

## Project Organization Chart

Organization Chart and Contact List for Environmental Management Team of Contractor

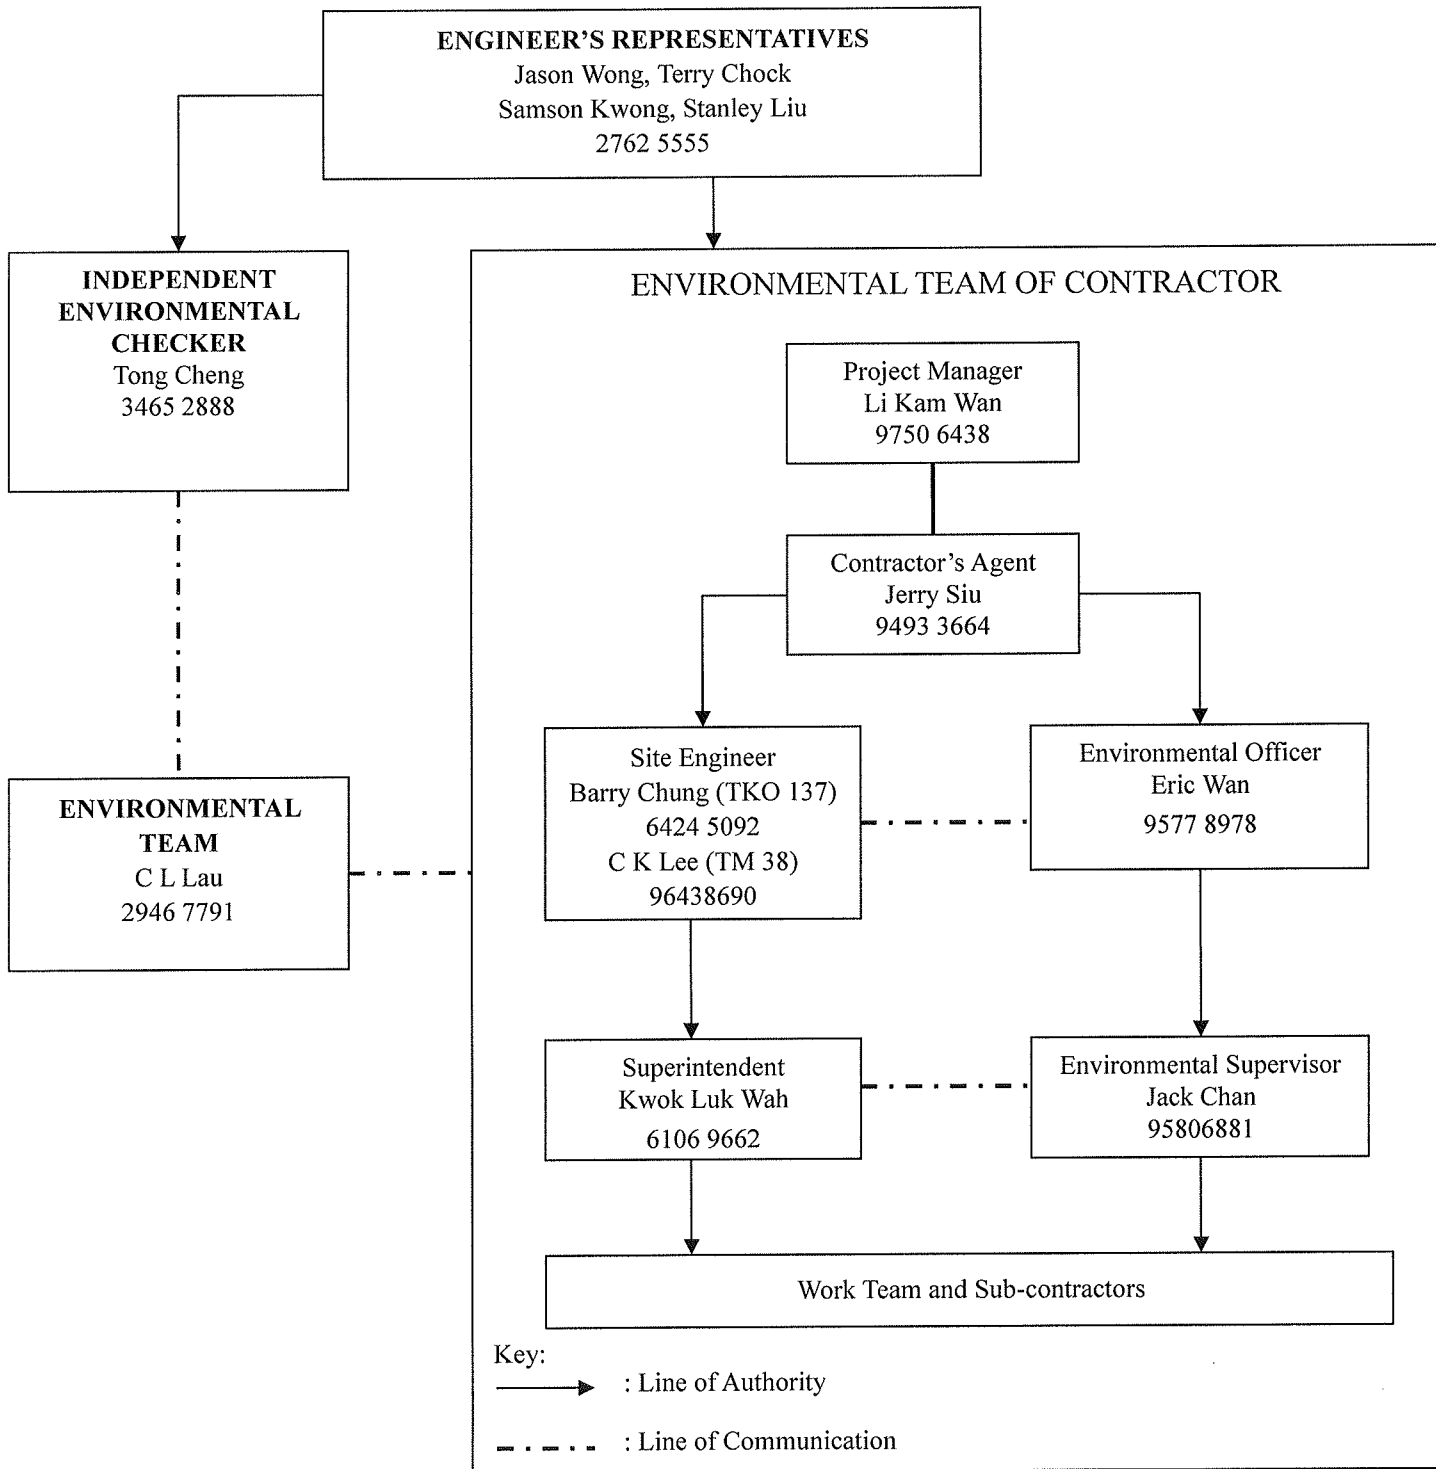

## **Appendix I**

### **B1**

# **Calibration Certificates for Impact Air Quality Monitoring Equipment**







東業德勤測試顧問有限公司  
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong  
Tel : 2695 8318 E-mail : etl@ets-testconsult.com  
Fax : 2695 3944 Web site : www.ets-testconsult.com


**Calibration Report**  
of  
**High Volume Air Sampler**

Manufacturer : Graseby GMW Date of Calibration : 03 March 2014  
Serial No. : 1172 (ET / EA / 003 / 11) Calibration Due Date : 02 May 2014  
Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results :

Flow recorder reading (cfm)	51	49	39	34	27
Qstd (Actual flow rate, m <sup>3</sup> /min)	1.79	1.64	1.39	1.15	0.87
Pressure :	763.56	mm Hg	Temp. :	290	K


**Sampler 1172 Calibration Curve**  
Site: Tseung Kwan O 137 (TKO-A2a)

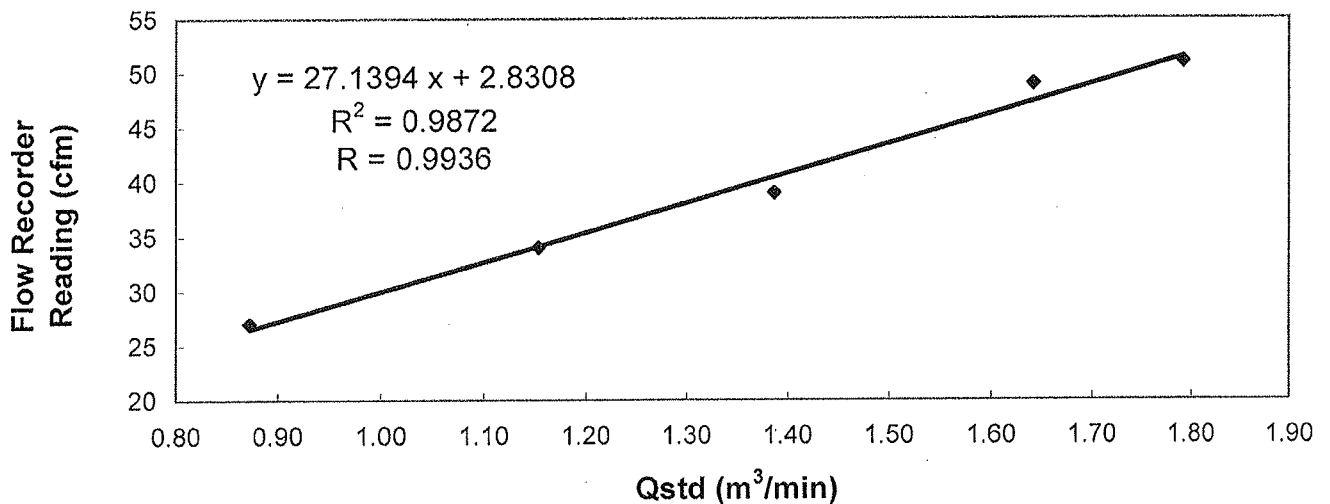

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by :   
TANG, Chung Hang  
(Site Technician)

Checked by :   
LAW, Sau Yee  
(Senior Environmental Officer)



TISCH ENVIRONMENTAL, INC.  
 145 SOUTH MIAMI AVE.  
 VILLAGE OF CLEVELAND, OH 45002  
 513.467.9000  
 877.263.7610 TOLL FREE  
 513.467.9009 FAX  
 WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT  
 ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - May 13, 2013 Roots-meter S/N 0438320 Ta (K) - 296  
 Operator Tisch Orifice I.D. - 2511 Pa (mm) - 753.11

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.4400	3.2	2.00
2	NA	NA	1.00	1.0110	6.4	4.00
3	NA	NA	1.00	0.9030	7.9	5.00
4	NA	NA	1.00	0.8630	8.8	5.50
5	NA	NA	1.00	0.7110	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
0.9934	0.6898	1.4125	0.9957	0.6915	0.8866
0.9892	0.9784	1.9976	0.9915	0.9807	1.2539
0.9871	1.0931	2.2334	0.9894	1.0957	1.4019
0.9860	1.1425	2.3424	0.9883	1.1452	1.4703
0.9808	1.3794	2.8251	0.9831	1.3827	1.7732
Qstd slope (m) = 2.05038			Qa slope (m) = 1.28391		
intercept (b) = -0.00442			intercept (b) = -0.00277		
coefficient (r) = 0.99995			coefficient (r) = 0.99995		
y axis = SQRT[H2O(Pa/760) (298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

$$Vstd = \text{Diff. Vol} [(Pa - \text{Diff. Hg}) / 760] (298 / Ta)$$

$$Qstd = Vstd / \text{Time}$$

$$Va = \text{Diff Vol} [(Pa - \text{Diff Hg}) / Pa]$$

$$Qa = Va / \text{Time}$$

For subsequent flow rate calculations:

$$Qstd = 1/m \{ [\text{SQRT}(H2O(Pa/760) (298/Ta))] - b \}$$

$$Qa = 1/m \{ [\text{SQRT} H2O(Ta/Pa)] - b \}$$

## **Appendix I**

### **B2**

## **Impact Air Quality Monitoring Results**

## Summary of 24-hr TSP Monitoring Results

Monitoring Station : TKO-A1  
Location : Site Egress

Start Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
06/03/14	09:48	07/03/14	09:48	20966.33	20990.33	24.00	1.1019	1.1019	1.1019	2.7765	3.0462	170
12/03/14	10:40	13/03/14	10:40	20994.33	21018.33	24.00	1.1019	1.1019	1.1019	2.7694	3.0342	167
18/03/14	09:00	19/03/14	09:00	21020.33	21044.33	24.00	1.1019	1.1019	1.1019	2.7527	2.9604	131
24/03/14	11:30	25/03/14	11:30	21048.33	21072.33	24.00	1.1019	1.1019	1.1019	2.7224	2.9173	123
29/03/14	09:00	30/03/14	09:00	21074.33	21098.33	24.00	1.1019	1.1019	1.1019	2.7722	3.0314	163

Monitoring Station : TKO-A2a  
Location : CREO

Start Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
06/03/14	09:31	07/03/14	09:31	20193.44	20217.44	24.00	1.0748	1.0748	1.0748	2.7483	3.0331	184
12/03/14	10:47	13/03/14	10:47	20221.44	20245.44	24.00	1.0748	1.0748	1.0748	2.7531	3.0324	180
18/03/14	09:00	19/03/14	09:00	21129.44	21153.44	24.00	1.0748	1.0748	1.0748	2.7438	2.9742	149
24/03/14	11:35	25/03/14	11:35	21157.44	21181.44	24.00	1.0748	1.0748	1.0748	2.7306	2.9423	137
29/03/14	09:00	30/03/14	09:00	21183.44	21207.44	24.00	1.0748	1.0748	1.0748	2.7695	3.0378	173



## Summary of 1-hr TSP Monitoring Results

Monitoring Station : TKO-A1  
Location : Site Egress

Date	Time		Elapsed Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
03/03/14	11:25	12:25	20964.33	20965.33	1.00	1.1019	1.1019	1.1019	2.7681	2.7857	266
05/03/14	09:00	10:00	20965.33	20966.33	1.00	1.1019	1.1019	1.1019	2.7841	2.8025	278
07/03/14	09:50	10:50	20990.33	20991.33	1.00	1.1019	1.1019	1.1019	2.7763	2.7957	293
07/03/14	10:50	11:50	20991.33	20992.33	1.00	1.1019	1.1019	1.1019	2.7694	2.7881	283
10/03/14	08:48	09:48	20992.33	20993.33	1.00	1.1019	1.1019	1.1019	2.7732	2.7906	263
12/03/14	09:35	10:35	20993.33	20994.33	1.00	1.1019	1.1019	1.1019	2.7833	2.8002	256
14/03/14	09:25	10:25	21018.33	21019.33	1.00	1.1019	1.1019	1.1019	2.7746	2.7923	268
17/03/14	09:50	10:50	21019.33	21020.33	1.00	1.1019	1.1019	1.1019	2.7553	2.7725	260
19/03/14	14:13	15:13	21044.33	21045.33	1.00	1.1019	1.1019	1.1019	2.7725	2.7909	278
19/03/14	15:20	16:20	21045.33	21046.33	1.00	1.1019	1.1019	1.1019	2.7694	2.7871	268
21/03/14	10:30	11:30	21046.33	21047.33	1.00	1.1019	1.1019	1.1019	2.7725	2.7910	280
24/03/14	10:00	11:00	21047.33	21048.33	1.00	1.1019	1.1019	1.1019	2.7365	2.7527	245
26/03/14	09:40	10:40	21072.33	21073.33	1.00	1.1019	1.1019	1.1019	2.7621	2.7765	218
28/03/14	08:48	09:48	21073.33	21074.33	1.00	1.1019	1.1019	1.1019	2.7704	2.7880	266
31/03/14	10:20	11:20	21098.33	21099.33	1.00	1.1019	1.1019	1.1019	2.7658	2.7828	257
31/03/14	11:40	12:40	21099.33	21100.33	1.00	1.1019	1.1019	1.1019	2.7704	2.7888	278

Monitoring Station : TKO-A2a  
Location : CREO

Date	Time		Elapsed Time		Sampling Time (hrs)	Flow Rate (m <sup>3</sup> /min.)		Average (m <sup>3</sup> /min.)	Filter Weight (g)		Conc. (µg/m <sup>3</sup> )
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
03/03/14	11:30	12:30	20191.44	20192.44	1.00	1.0748	1.0748	1.0748	2.7540	2.7708	261
05/03/14	09:05	10:05	20192.44	20193.44	1.00	1.0748	1.0748	1.0748	2.7362	2.7541	278
07/03/14	09:36	10:36	20217.44	20218.44	1.00	1.0748	1.0748	1.0748	2.7482	2.7655	268
07/03/14	10:36	11:36	20218.44	20219.44	1.00	1.0748	1.0748	1.0748	2.7533	2.7702	262
10/03/14	08:56	09:56	20219.44	20220.44	1.00	1.0748	1.0748	1.0748	2.7821	2.8003	282
12/03/14	09:42	10:42	20220.44	20221.44	1.00	1.0748	1.0748	1.0748	2.7821	2.7994	268
14/03/14	09:34	10:34	21127.44 *	21128.44	1.00	1.0748	1.0748	1.0748	2.7805	2.7969	254
17/03/14	09:40	10:40	21128.44	21129.44	1.00	1.0748	1.0748	1.0748	2.7497	2.7685	292
19/03/14	14:19	15:19	21153.44	21154.44	1.00	1.0748	1.0748	1.0748	2.7693	2.7866	268
19/03/14	15:25	16:25	21154.44	21155.44	1.00	1.0748	1.0748	1.0748	2.7712	2.7877	256
21/03/14	10:38	11:38	21155.44	21156.44	1.00	1.0748	1.0748	1.0748	2.7734	2.7904	264
24/03/14	10:05	11:05	21156.44	21157.44	1.00	1.0748	1.0748	1.0748	2.7447	2.7637	295
26/03/14	09:45	10:45	21181.44	21182.44	1.00	1.0748	1.0748	1.0748	2.7738	2.7914	273
28/03/14	08:54	09:54	21182.44	21183.44	1.00	1.0748	1.0748	1.0748	2.7695	2.7857	251
31/03/14	10:25	11:25	21207.44	21208.44	1.00	1.0748	1.0748	1.0748	2.7742	2.7896	239
31/03/14	11:45	12:45	21208.44	21209.44	1.00	1.0748	1.0748	1.0748	2.7432	2.7536	161

Remark: (\*) Only elapsed timer was replaced after maintenance work on 14/03/14 and re-calibration was not required due to the event.




## Appendix I

### B3


## Graphical Plots of Impact Air Quality Monitoring Data



### 24-hour TSP level at TKO-A1

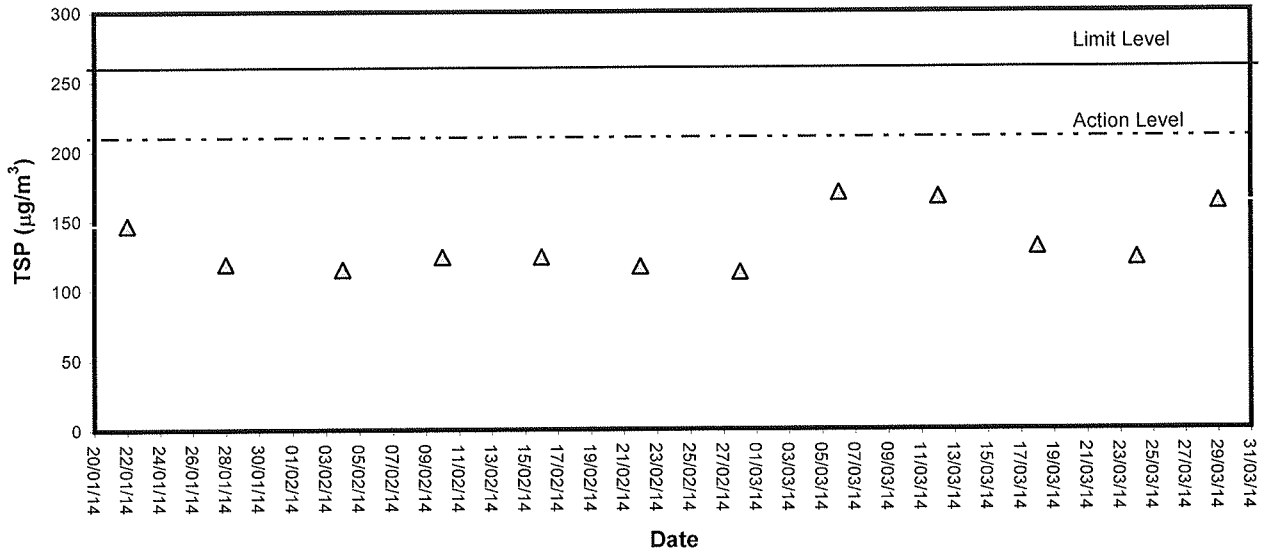


### 24-hour TSP level at TKO-A2a

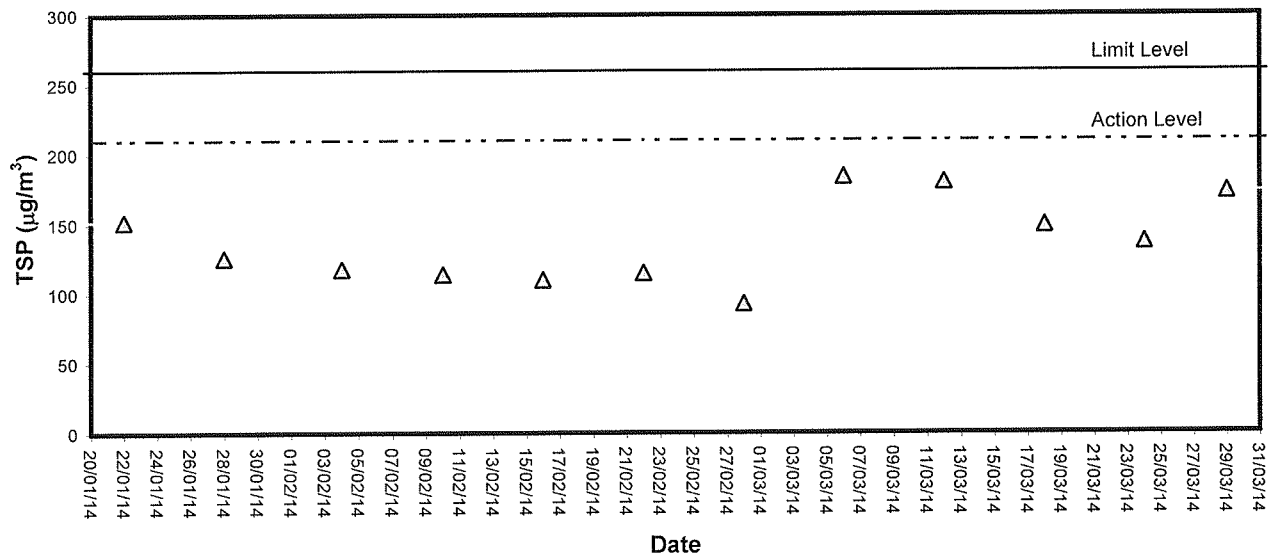




1-hour TSP level at TKO-A1

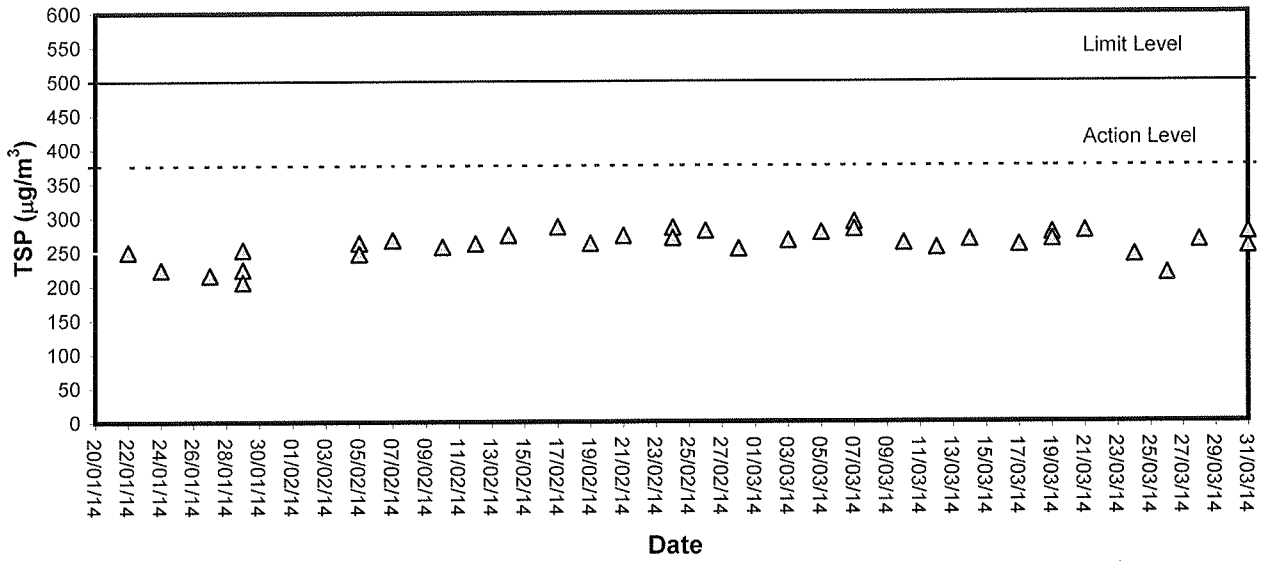

1-hour TSP level at TKO-A2a

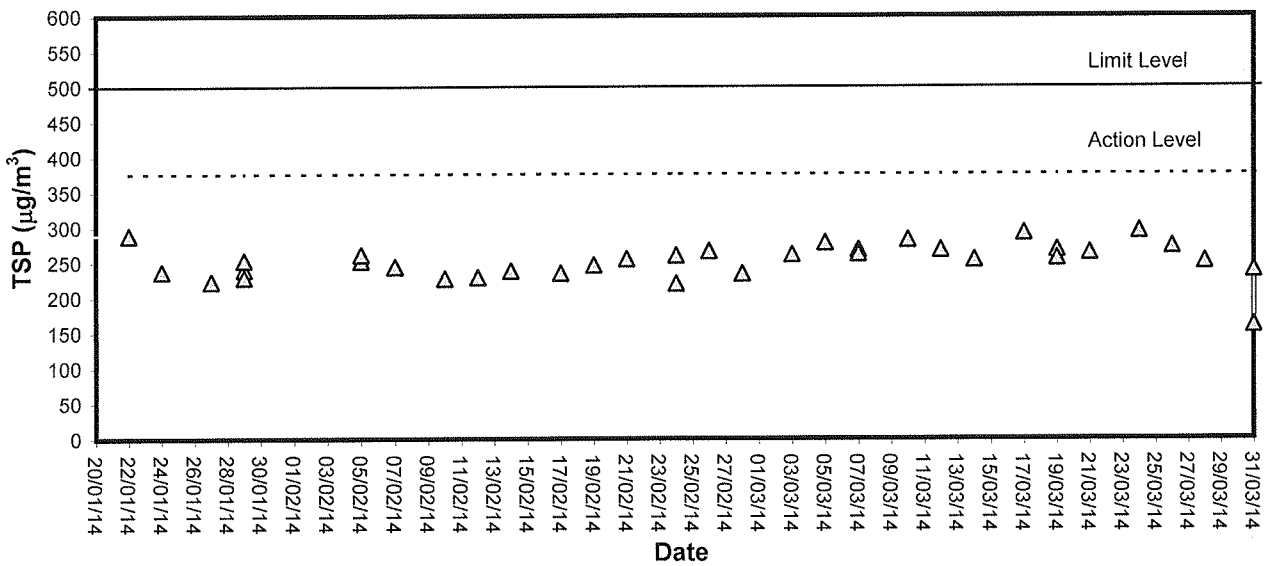





## Appendix I

### C1

## Calibration Certificates for Impact Noise Monitoring Equipment



# Calibration Certificate

Certificate No. **38224**

Page 1 of 2 Pages

**Customer :** ETS-Testconsult Limited

**Address :** 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

**Order No. :** Q33271

**Date of receipt :** 13-Nov-13

## Item Tested

**Description :** Sound Level Calibrator (ET/EN/002/01)

**Manufacturer :** Rion

**Model :** NC-73

**Serial No. :** 10196943

## Test Conditions

**Date of Test :** 15-Nov-13

**Ambient Temperature :** (23 ± 3)°C

**Supply Voltage :** --

**Relative Humidity :** (50 ± 25) %

## Test Specifications

Calibration check.

Ref. Document/Procedure : F21, Z02.

## Test Results

All results were within the manufacturer's specification.


The results are shown in the attached page(s).


Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S014	Spectrum Analyzer	35730	NIM-PRC & SCL-HKSAR
S205	Ref. Sound Level Calibrator	PHCO40002	SCL-HKSAR
S041	Universal Counter	34621	SCL-HKSAR
S206	Sound Level Meter	36203	SCL-HKSAR
S031	6½ dgt. Multimeter	30128	NIM-PRC

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).  
The test results apply to the above Unit-Under-Test only

**Calibrated by :**   
Dorothy Cheuk

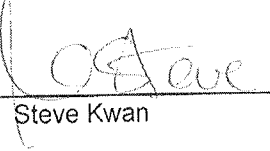**Approved by :**   
Steve Kwan

**Date:** 15-Nov-13

This Certificate is issued by:  
Hong Kong Calibration Ltd.  
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.  
Tel: 2425 8801 Fax: 2425 8846

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



# Calibration Certificate

Certificate No. 38224

Page 2 of 2 Pages

Results :

## 1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94 dB	94.1 dB	$\pm 1$ dB

Uncertainty :  $\pm 0.2$  dB

## 2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	0.986 kHz	$\pm 2$ %

Uncertainty :  $\pm 0.1$  %

## 3. Level Stability : 0.0 dB

Uncertainty :  $\pm 0.01$  dB

## 4. Total Harmonic Distortion : $< 0.1$ %

Mfr's Spec. :  $< 3$  %

Uncertainty :  $\pm 2.3$  % of reading

Remarks: 1. UUT : Unit-Under-Test  
2. The uncertainty claimed is for a confidence probability of not less than 95%.  
3. Atmospheric Pressure : 1006 hPa

----- END -----



# Calibration Certificate

Certificate No. **38223**

**Customer :** ETS-Testconsult Limited

**Address :** 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

**Order No. :** Q33271

**Date of receipt :** 13-Nov-13

## Item Tested

**Description :** Precision Integrating Sound Level Meter (ET/EN/003/13)

**Manufacturer :** Rion

**Model :** NL-31

**Serial No. :** 00593620

## Test Conditions

**Date of Test :** 15-Nov-13

**Ambient Temperature :** (23 ± 3)°C

**Supply Voltage :** --

**Relative Humidity :** (50 ± 25) %

## Test Specifications

Calibration check.

Ref. Document/Procedure : Z01.

## Test Results

All results were within the IEC 651 Type 1 & IEC 804 Type1 specification.  
The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S017	Multi-Function Generator	C127181	SCL-HKSAR
S205	Ref. Sound Level Calibrator	PHCO40002	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).  
The test results apply to the above Unit-Under-Test only

**Calibrated by :**   
Dorothy Cheuk

**Approved by :**   
Steve Kwan

**Date:** 15-Nov-13

This Certificate is issued by:  
Hong Kong Calibration Ltd.  
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.  
Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



# Calibration Certificate

Certificate No. 38223

Results :

## 1. SPL Accuracy

UUT Setting			Applied Value (dB)	UUT Reading (dB)
Level Range (dB)	Weight	Response		
20 - 100	L <sub>A</sub>	Fast	94.0	94.0
		Slow		94.0
	L <sub>C</sub>	Fast		94.0
		L <sub>p</sub>		Fast
30 - 120	L <sub>A</sub>	Fast	94.0	94.0
		Slow		94.0
	L <sub>C</sub>	Fast		94.0
		L <sub>p</sub>		Fast
30 - 120	L <sub>A</sub>	Fast	114.0	114.0
		Slow		114.0
	L <sub>C</sub>	Fast		114.0
		L <sub>p</sub>		Fast

IEC 651 Type 1 Spec. :  $\pm 0.7$  dB  
Uncertainty :  $\pm 0.1$  dB

2. **Level Stability** : 0.0 dB  
IEC 651 Type 1 Spec. :  $\pm 0.3$  dB  
Uncertainty :  $\pm 0.01$  dB

## 3. Linearity

### 3.1 Level Linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec. (Primary Indicator Range)
130	114.0	114.0	0.0	$\pm 0.7$ dB
130	104.0	104.0	0.0	
120	94.0	94.0 (Ref.)	- -	
110	84.0	84.0	0.0	
100	74.0	74.0	0.0	
90	64.0	64.1	0.1	
80	54.0	54.1	0.1	

Uncertainty :  $\pm 0.1$  dB



# Calibration Certificate

Certificate No. 38223

Page 3 of 3 Pages

## 3.2 Differential level linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec.
120	84.0	84.0	0.0	± 0.4 dB
	94.0	94.0 (Ref.)	--	
	95.0	95.0	0.0	± 0.2 dB

Uncertainty : ± 0.1 dB

## 4. Frequency Weighting - A weighting

Frequency	Attenuation (dB)	IEC 651 Type 1 Spec.
31.5 Hz	39.6	- 39.4 dB, ± 1.5 dB
63 Hz	-36.3	- 26.2 dB, ± 1.5 dB
125 Hz	-16.3	- 16.1 dB, ± 1 dB
250 Hz	-8.7	- 8.6 dB, ± 1 dB
500 Hz	-3.3	- 3.2 dB, ± 1 dB
1 kHz	0.0 (Ref.)	0 dB, ± 1 dB
2 kHz	+1.2	+ 1.2 dB, ± 1 dB
4 kHz	+1.1	+ 1.0 dB, ± 1 dB
8 kHz	-1.0	- 1.1 dB, + 1.5 dB ~ - 3 dB
16 kHz	-6.4	- 6.6 dB, + 3 dB ~ ∞

Uncertainty : ± 0.1 dB

## 5. Time Averaging

6.

Applied Burst duty Factor	Applied Leq Value (dB)	UUT Reading (dB)	IEC 804 Type 1 Spec.
continuous	40.0	40.0	--
1/10	40.0	39.9	± 0.5 dB
1/10 <sup>2</sup>	40.0	39.7	
1/10 <sup>3</sup>	40.0	39.8	± 1.0 dB
1/10 <sup>4</sup>	40.0	39.8	

Uncertainty : ± 0.1 dB

- Remarks:
1. UUT : Unit-Under-Test
  2. The uncertainty claimed is for a confidence probability of not less than 95%.
  3. Atmospheric Pressure : 1006 hPa
  4. The UUT was adjusted with the supplied sound calibrator at the reference sound pressure level before the calibration.

----- END -----



## **Appendix I**

### **C2**

## **Impact Noise Monitoring Results**



## Day-time Noise Monitoring

Monitoring Location: TKO-N1 (Site Egress)

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L <sub>eq</sub> (30min)	L <sub>10</sub>	L <sub>90</sub>		
12/03/14	09:28	61.0	62.3	57.4	0.4	Cloudy






## Appendix I

### C3

## Graphical Plots of Impact Noise Monitoring Data



## Noise Monitoring (Day-time)

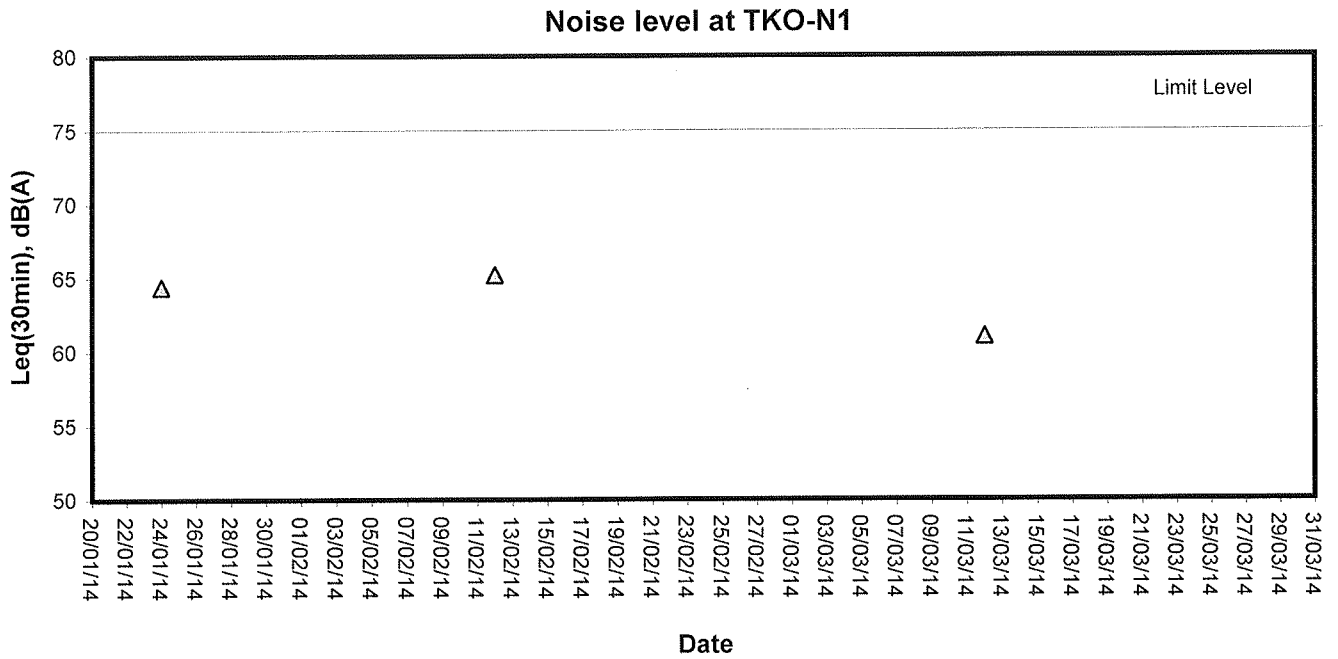



## Appendix I

### D1

## Calibration Certificates for Impact Marine Water Quality Monitoring Equipments



## Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/010                      Manufacturer : HACH  
Model No. : 2100Q                                      Serial No. : 11110 C 014260  
Date of Calibration : 07/01/2014                      Due Date : 06/04/2014

Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	19.2	-4.08
100	104	3.92
800	793	-0.88


(\*) Difference = (Measured Value – Theoretical Value) / Theoretical Value

Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 



### Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/004</u>	Manufacturer : <u>YSI</u>
Model No. : <u>Pro 2030</u>	Serial No. : <u>10F 101978</u>
Date of Calibration : <u>29/01/2014</u>	Calibration Due Date : <u>28/04/2014</u>

**Temperature Verification**

Ref. No. of Reference Thermometer : ET/0521/008

Ref. No. of Water Bath : ---

		Temperature (°C)		
Reference Thermometer reading	Measured	20.2	Corrected	19.8
DO Meter reading	Measured	19.6	Difference	0.2

**Standardization of sodium thiosulphate (Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>) solution**

Reagent No. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> titrant	CPE/012/4.5/001/8	Reagent No. of 0.025N K <sub>2</sub> Cr <sub>2</sub> O <sub>7</sub>	CPE/012/4.4/001/24
		Trial 1	Trial 2
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		0.00	10.50
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		10.50	20.95
Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)		10.50	10.45
Normality of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02381	0.02392
Average Normality (N) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02387	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>, N = 0.25 / ml Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub> used

**Linearity Checking**

**Determination of dissolved oxygen content by Winkler Titration \***

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	11.30	22.40	0.00	8.20	13.20
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	11.30	22.40	30.80	8.20	13.20	18.10
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	11.30	11.10	8.40	8.20	5.00	4.90
Dissolved Oxygen (DO), mg/L	7.24	7.11	5.38	5.25	3.20	3.14
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.23	7.11	7.17	7.24	7.11	7.18	0.14
5	5.33	5.17	5.25	5.38	5.25	5.32	1.32
10	3.30	3.12	3.21	3.20	3.14	3.17	1.25
Linear regression coefficient						0.9990	



### Internal Calibration Report of Dissolved Oxygen Meter

*Zero Point Checking*

DO meter reading, mg/L	0.00
------------------------	------

*Salinity Checking*

Reagent No. of NaCl (10ppt)	CPE/012/4.7/002/15	Reagent No. of NaCl (30ppt)	CPE/012/4.8/002/15
-----------------------------	--------------------	-----------------------------	--------------------

*Determination of dissolved oxygen content by Winkler Titration \*\**

Salinity (ppt)	10		30	
	1	2	1	2
Trial				
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	12.00	24.30	35.30
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	12.00	24.30	35.30	46.50
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	12.00	12.30	11.00	11.20
Dissolved Oxygen (DO), mg/L	7.69	7.88	7.05	7.18
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation:  $DO (mg/L) = V \times N \times 8000/298$

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.81	7.92	7.87	7.69	7.88	7.79	1.02
30	7.33	7.42	7.38	7.05	7.18	7.12	3.59

*Acceptance Criteria*

- (1) Differenc between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / does not comply # with the specified requirements and is deemed acceptable # / unacceptable # for use.

# Delete as appropriate

Calibrated by :

Approved by :



## Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/004      Manufacturer : YSI  
Model No. : Pro 2030      Serial No. : 10F 101978  
Date of Calibration : 29/01/2014      Due Date : 28/04/2014

Ref. No. of Salinity Standard used (30ppt)

S/001/5


Salinity Standard (ppt)	Measured Salinity (ppt)	Difference %
30.0	32.3	7.38

Acceptance Criteria

Difference : <10 %

The salinity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 



## Appendix I

### D2

## Impact Marine Water Quality Monitoring Results



# Mid-Flood Tide

## Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average
03/03/14	1800-1820	18/Cloudy	Surface	1.0	17.0	29.1	29.2	7.12	7.15	93.1	93.4	2.27	2.25	3.6	3.4	2.50	3.5	3.6	
			Middle	9.8	17.2	29.3	29.3	7.28	7.30	95.2	95.5	2.22	2.44	3.2	3.5				
			Bottom	18.6	17.3	29.2	29.4	7.31	7.22	95.7	94.5	2.46	2.81	3.6	3.8				
05/03/14	0800-0820	17/Cloudy	Surface	1.0	17.3	29.3	29.0	7.23	7.15	94.6	93.6	2.83	2.72	3.8	3.7	2.86	3.9	3.9	
			Middle	10.4	17.4	29.1	29.1	7.17	7.05	93.8	92.3	2.73	2.83	3.8	3.9				
			Bottom	19.8	17.4	29.0	29.1	7.04	7.02	92.4	91.9	2.86	3.03	4.0	4.1				
07/03/14	0915-0931	17/Cloudy	Surface	1.0	17.1	29.1	29.1	7.01	7.03	91.7	94.5	3.04	2.16	3.2	3.3	2.41	3.5	3.6	
			Middle	9.9	17.3	29.2	29.3	7.21	7.24	94.2	96.5	2.18	2.35	3.4	3.5				
			Bottom	18.8	17.4	29.3	29.4	7.26	7.31	94.8	95.6	2.33	2.72	3.4	3.9				
10/03/14	0825-0838	16/Cloudy	Surface	1.0	17.1	29.2	29.1	7.02	7.03	95.4	85.6	2.70	2.35	3.8	3.4	2.55	3.5	3.6	
			Middle	10.2	17.3	29.3	29.3	7.37	7.19	87.6	87.7	2.50	2.50	3.6	3.5				
			Bottom	19.3	17.2	29.4	29.4	7.18	7.16	87.2	87.2	2.49	2.80	3.8	3.9				
12/03/14	1430-1454	19/Cloudy	Surface	1.0	17.5	29.4	29.4	7.18	7.19	94.1	94.2	2.20	2.21	3.6	3.4	2.39	3.5	3.5	
			Middle	9.8	17.6	29.3	29.4	7.19	7.04	94.2	92.3	2.21	2.40	3.2	3.5				
			Bottom	18.6	17.6	29.4	29.4	7.03	6.94	92.3	91.0	2.39	2.57	3.4	3.7				
14/03/14	1600-1618	18/Cloudy	Surface	1.0	17.3	29.2	29.3	7.44	7.45	91.0	92.2	2.56	2.24	3.6	3.4	2.36	3.5	3.5	
			Middle	9.6	17.5	29.3	29.4	7.45	7.31	92.2	90.4	2.24	2.39	3.6	3.5				
			Bottom	18.2	17.5	29.4	29.5	7.30	7.22	90.4	89.2	2.38	2.46	3.4	3.5				
17/03/14	1730-1750	18/Cloudy	Surface	1.0	17.4	29.4	29.4	7.21	7.43	89.1	92.1	2.47	3.48	4.8	4.6	3.39	4.7	4.5	
			Middle	10.3	17.4	29.5	29.5	7.23	7.33	89.3	90.8	2.47	3.64	4.8	4.7				
			Bottom	19.6	17.5	29.5	29.5	7.46	6.82	92.4	84.6	3.49	3.05	4.0	4.1				
19/03/14	0810-0825	24/Cloudy	Surface	1.0	17.0	26.0	26.0	7.15	7.15	86.5	86.5	2.63	2.64	4.0	3.8	2.31	3.3	3.4	
			Middle	9.8	16.9	26.1	26.1	7.14	7.10	86.4	85.8	2.64	2.22	3.6	3.3				
			Bottom	18.6	16.9	26.2	26.2	7.09	7.03	85.7	85.0	2.23	2.07	3.2	3.1				

**Mid-Flood Tide**

**Monitoring Station : TKO-C1**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/14	0835-0847	21/Cloudy	Surface	1.0	16.9	25.9	26.0	7.13	7.12	86.3	86.2	2.69	2.67	3.6	3.7	3.4			
			Middle	9.9	16.9	26.0	26.2	7.11	7.21	86.0	87.1	2.65	2.25	3.8	3.3				
			Bottom	18.8	16.8	26.1	26.3	7.23	7.11	86.9	85.9	2.21	2.00	3.2	3.1				
24/03/14	1000-1018	22/Cloudy	Surface	1.0	17.3	26.2	26.1	7.19	6.93	86.1	84.8	1.98	2.37	3.2	3.6	3.7			
			Middle	9.5	17.2	26.3	26.2	7.09	6.73	85.6	82.1	2.01	2.46	3.6	3.7				
			Bottom	18.0	17.1	26.1	26.3	6.96	6.72	81.9	81.4	2.47	2.83	4.0	3.9				
26/03/14	1300-1320	21/Fine	Surface	1.0	17.6	26.3	29.4	6.74	7.17	81.1	88.4	2.86	2.22	3.6	3.6	3.5			
			Middle	9.9	17.7	29.4	29.5	7.16	7.03	88.3	86.7	2.22	2.38	3.6	3.3				
			Bottom	18.7	17.8	29.5	29.6	7.01	6.90	86.5	85.2	2.37	2.58	3.4	3.7				
28/03/14	1530-1545	23/Cloudy	Surface	1.0	19.0	29.4	27.0	7.04	7.17	85.3	90.0	2.59	2.59	3.6	3.7	3.5			
			Middle	9.8	18.8	29.5	26.9	6.89	7.06	85.1	88.7	2.57	2.39	3.8	3.5				
			Bottom	18.6	18.6	27.0	27.1	7.14	7.01	89.6	88.0	2.62	2.29	3.2	3.3				
31/03/14	1730-1750	23/Rainy	Surface	1.0	18.1	27.1	26.2	7.08	7.29	87.6	88.2	2.27	2.96	4.0	4.0	3.8			
			Middle	10.0	18.4	26.1	27.3	7.04	7.08	88.4	85.7	2.31	2.66	4.0	3.7				
			Bottom	18.9	18.5	27.4	27.8	7.26	6.75	82.1	81.8	2.84	2.83	4.0	3.8				

**Mid-Flood Tide**

**Monitoring Station : TKO-M4**



東業德動測試顧問有限公司  
ETS-TESTCONSULT LIMITED

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	
03/03/14	1940-2000	18/Cloudy	Surface	17.1	29.3	29.3	7.26	7.24	95.0	94.7	2.35	2.32	3.4	3.3	3.5			
				17.3	29.2	29.2	7.22	7.09	94.4	92.7	2.29	2.47	3.2	3.6				
				17.4	29.5	29.5	7.07	7.26	92.5	95.0	2.46	2.63	3.6	3.7				
			Middle	17.4	28.8	28.9	7.24	7.25	94.7	94.9	3.00	3.02	4.0	4.1				
				17.4	29.0	29.0	7.12	7.11	95.0	93.1	3.04	3.28	4.2	4.3				
				17.4	29.0	29.0	7.10	7.05	93.2	92.2	4.4	4.3	4.2	4.1				
05/03/14	0940-1000	17/Cloudy	Surface	17.2	29.1	29.1	7.04	7.05	92.1	92.3	3.11	3.12	4.0	4.1	4.2			
				17.3	29.2	29.2	7.35	7.33	92.3	95.8	3.13	2.23	3.4	3.3				
				17.5	29.1	29.1	7.31	7.18	96.1	88.0	2.26	2.41	3.4	3.5				
			Middle	17.3	29.3	29.3	7.19	7.04	95.5	85.7	2.20	2.48	3.2	3.3				
				17.4	29.4	29.4	7.16	7.12	94.0	93.8	2.37	2.38	3.4	3.4				
				17.5	29.4	29.4	7.36	7.35	93.6	96.1	2.38	2.54	3.4	3.7				
07/03/14	1044-1100	17/Cloudy	Surface	17.3	29.5	29.5	7.34	7.22	95.9	86.7	2.52	2.55	3.6	3.6	3.5			
				17.4	29.3	29.3	7.26	7.22	88.4	88.0	2.42	2.41	3.6	3.5				
				17.4	29.2	29.2	7.18	7.04	87.5	85.7	2.40	2.48	3.4	3.3				
			Middle	17.4	29.1	29.1	7.01	7.06	85.4	86.0	2.47	2.46	3.2	3.3				
				17.5	29.4	29.4	7.10	7.12	86.0	86.7	2.49	2.55	3.4	3.6				
				17.5	29.5	29.5	7.13	7.12	86.5	86.8	2.57	2.62	3.6	3.9				
10/03/14	0945-1000	16/Cloudy	Surface	17.3	29.4	29.4	7.06	7.05	92.2	92.4	2.61	2.62	4.0	4.0	3.2			
				17.4	29.3	29.3	7.46	7.47	92.4	92.5	2.19	2.21	3.0	3.0				
				17.5	29.3	29.3	7.47	7.32	92.5	91.5	2.22	2.31	3.0	3.3				
			Middle	17.5	29.6	29.6	7.38	7.39	91.4	90.0	2.30	2.37	3.4	3.3				
				17.6	29.5	29.5	7.39	7.27	91.6	89.8	2.31	2.37	3.2	3.3				
				17.6	29.6	29.6	7.28	7.18	90.1	88.7	2.38	3.17	3.4	4.1				
12/03/14	1612-1630	19/Cloudy	Surface	17.4	29.4	29.4	7.16	7.18	89.1	88.9	3.15	3.17	4.2	4.1	4.1			
				17.5	29.5	29.5	7.19	6.97	88.7	86.3	3.19	2.93	4.0	3.9				
				17.5	29.5	29.5	6.99	6.94	86.6	86.3	2.94	2.93	3.8	3.9				
			Middle	17.5	29.5	29.5	6.94	6.94	85.9	86.1	2.92	3.22	4.0	4.3				
				17.6	29.5	29.5	6.97	6.94	86.4	86.1	3.21	3.22	4.2	4.3				
				17.6	29.5	29.5	6.91	7.23	85.7	87.4	3.23	1.94	4.4	3.0				
14/03/14	1739-1800	18/Cloudy	Surface	17.4	26.1	26.2	7.22	7.23	87.3	87.4	1.93	1.94	3.0	3.0	3.1			
				17.5	26.2	26.2	7.14	7.14	87.4	86.3	1.94	2.08	3.0	3.1				
				17.5	26.1	26.1	7.13	7.14	86.3	86.3	2.07	2.08	3.2	3.1				
			Middle	17.6	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
				17.6	26.2	26.2	7.03	7.05	84.9	85.1	2.38	2.38	3.2	3.3				
				17.6	26.2	26.2	7.03	7.05	84.9	85.1	2.38	2.38	3.2	3.3				
17/03/14	1910-1930	18/Cloudy	Surface	16.9	26.2	26.2	7.14	7.14	86.2	86.3	2.08	2.08	3.0	3.0	4.1			
				16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
			Middle	16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
19/03/14	0940-1000	24/Cloudy	Surface	16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3	3.1			
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
				16.8	26.2	26.2	7.03	7.05	84.9	85.1	2.38	2.38	3.2	3.3				
			Middle	16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
19/03/14	0940-1000	24/Cloudy	Surface	16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3	3.1			
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
				16.8	26.2	26.2	7.03	7.05	84.9	85.1	2.38	2.38	3.2	3.3				
			Middle	16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
19/03/14	0940-1000	24/Cloudy	Surface	16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3	3.1			
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
				16.8	26.2	26.2	7.03	7.05	84.9	85.1	2.38	2.38	3.2	3.3				
			Middle	16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
19/03/14	0940-1000	24/Cloudy	Surface	16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3	3.1			
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				
				16.8	26.2	26.2	7.03	7.05	84.9	85.1	2.38	2.38	3.2	3.3				
			Middle	16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.9	26.1	26.1	7.13	7.14	86.2	86.3	2.08	2.08	3.0	3.1				
				16.8	26.2	26.2	7.06	7.05	85.3	85.1	2.37	2.38	3.4	3.3				

# Mid-Flood Tide

## Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/14	0945-1000	21/Cloudy	Surface	1.0	26.1	26.1	7.16	7.14	86.7	86.3	1.94	1.96	3.0	3.0	3.3		
					26.0	7.12	85.9	2.08	3.2								
			Middle	4.3	26.1	26.2	7.08	7.04	85.5	85.0	2.10	2.09	3.4	3.3			
					26.2	7.00	84.5	2.45	3.4								
			Bottom	7.6	26.4	26.4	7.17	7.15	86.6	86.4	2.49	2.47	3.6	3.5			
					26.3	7.13	86.1	2.55	3.6								
24/03/14	1140-1200	22/Cloudy	Surface	1.0	26.1	26.2	7.06	7.07	86.3	86.5	2.51	2.53	3.4	3.5	3.6		
					26.2	7.08	86.6	2.80	3.8								
			Middle	4.5	26.3	26.3	6.97	6.98	85.0	85.2	2.83	2.82	4.0	3.9			
					26.3	6.99	85.3	2.12	3.2								
			Bottom	8.0	26.4	26.4	6.80	6.82	82.3	82.6	2.17	2.15	3.4	3.3			
					26.4	6.84	82.8	2.31	3.4								
26/03/14	1440-1500	21/Fine	Surface	1.0	29.4	29.4	7.29	7.29	89.9	89.9	2.34	2.33	3.2	3.3	3.6		
					29.3	7.28	89.8	2.47	3.6								
			Middle	4.4	29.5	29.5	7.17	7.17	88.5	88.4	2.45	2.46	3.8	3.7			
					29.4	7.16	88.3	2.64	4.0								
			Bottom	7.7	29.5	29.5	7.04	7.06	86.9	87.1	2.63	2.64	4.0	3.9			
					29.5	7.07	87.2	2.43	3.4								
28/03/14	1715-1730	23/Cloudy	Surface	1.0	26.9	26.9	7.08	7.09	88.9	89.0	2.37	2.40	3.2	3.3	3.4		
					26.9	7.10	89.1	2.35	3.4								
			Middle	4.4	27.0	27.0	7.05	7.07	88.5	88.8	2.39	2.37	3.6	3.5			
					27.0	7.09	89.0	2.30	3.4								
			Bottom	7.8	27.1	27.1	6.92	6.94	86.8	87.1	2.26	2.28	4.2	4.1			
					27.1	6.96	87.4	2.95	4.0								
31/03/14	1910-1930	23/Rainly	Surface	1.0	26.5	26.3	7.18	7.18	86.9	86.9	2.98	2.97	4.0	4.1	3.9		
					26.1	7.17	86.8	2.75	3.6								
			Middle	4.5	27.2	27.3	7.06	7.05	85.5	85.4	2.81	2.78	3.8	3.7			
					27.4	7.04	85.3	2.88	3.8								
			Bottom	8.0	27.8	27.9	6.96	6.93	84.3	83.9	2.91	2.90	4.0	3.9			
					27.9	6.89	83.5										

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Depth-average	Value
03/03/14	1300-1320	18/Cloudy	Surface	1.0	17.1	29.1	29.1	7.03	7.06	91.8	92.2	2.36	2.34	3.4	3.3	3.7	3.4	3.3	3.7
			Middle	9.7	17.1	29.2	29.3	7.19	7.21	94.0	94.2	2.51	2.53	3.6	3.7				
			Bottom	18.4	17.3	29.3	29.4	7.22	7.13	94.3	93.3	2.55	2.90	3.8	4.0				
05/03/14	1430-1450	17/Cloudy	Surface	1.0	17.4	28.8	28.8	7.49	7.47	98.0	97.7	2.89	2.88	3.6	3.8	4.1	3.6	4.0	4.2
			Middle	10.0	17.4	28.9	28.9	7.17	7.14	93.8	93.4	3.14	3.14	4.0	4.2				
			Bottom	19.0	17.5	28.9	29.0	7.11	7.06	93.0	92.4	3.13	3.34	4.2	4.4				
07/03/14	1535-1555	17/Cloudy	Surface	1.0	17.3	29.3	29.4	7.01	7.03	92.1	91.9	2.38	2.41	3.2	3.3	3.6	3.4	3.6	3.6
			Middle	9.6	17.5	29.5	29.5	7.20	7.23	94.0	94.4	2.47	2.45	3.6	3.6				
			Bottom	18.5	17.4	29.6	29.6	7.26	7.21	94.8	94.2	2.42	2.81	3.6	3.9				
10/03/14	1915-1930	17/Cloudy	Surface	1.0	17.3	29.3	29.4	7.00	7.01	94.3	85.4	2.80	2.39	3.8	3.3	3.6	3.4	3.6	3.3
			Middle	10.0	17.5	29.7	29.6	7.09	7.10	86.4	86.5	2.52	2.54	3.2	3.7				
			Bottom	19.0	17.4	29.6	29.7	7.11	7.12	86.6	86.7	2.55	2.80	3.8	3.9				
12/03/14	0900-0924	18/Cloudy	Surface	1.0	17.4	29.4	29.4	7.07	7.08	92.5	92.6	2.41	2.42	3.6	3.5	3.7	3.6	3.7	3.5
			Middle	9.7	17.4	29.5	29.5	6.93	6.94	90.8	90.9	2.42	2.57	3.4	3.7				
			Bottom	18.4	17.5	29.5	29.5	6.84	6.85	89.6	89.7	2.56	2.64	3.8	3.8				
14/03/14	1000-1018	18/Cloudy	Surface	1.0	17.3	29.2	29.2	7.38	7.39	89.8	89.7	2.63	2.64	3.8	3.8	3.5	3.4	3.5	3.5
			Middle	9.4	17.4	29.3	29.4	7.39	7.25	91.2	91.3	2.32	2.33	3.6	3.3				
			Bottom	17.8	17.5	29.4	29.5	7.25	7.16	88.6	88.5	2.47	2.55	3.4	3.7				
17/03/14	1230-1250	19/Cloudy	Surface	1.0	17.3	29.4	29.4	7.28	7.26	89.7	90.0	3.19	3.17	4.0	4.1	4.2	4.0	4.0	4.1
			Middle	10.0	17.4	29.5	29.5	7.17	7.18	90.2	89.1	3.14	3.54	4.2	4.7				
			Bottom	19.0	17.5	29.5	29.5	7.19	6.73	89.2	83.5	3.51	2.96	4.6	3.9				
19/03/14	1330-1350	24/Cloudy	Surface	1.0	17.0	26.0	26.0	7.04	7.03	83.1	85.1	2.98	2.76	4.0	3.7	3.4	3.8	3.8	3.7
			Middle	9.9	16.9	26.1	26.1	7.02	7.12	84.9	85.9	2.74	2.34	3.8	3.3				
			Bottom	18.8	16.8	26.1	26.1	7.14	7.02	85.6	84.7	2.37	2.09	3.2	3.1				

**Monitoring Station : TKO-C1**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/14	1430-1448	21/Cloudy	Surface	16.9	26.0	26.1	7.07	7.06	7.11	85.6	85.5		2.75	2.73		3.6	3.7	
			Middle	16.8	26.3	26.3	7.05	7.15	7.11	85.3	86.4	2.36	2.71	2.31	3.8	3.3	3.4	
			Bottom	16.7	26.2	26.4	7.17	7.13	7.05	86.6	85.2		2.27	2.06	3.2	3.4	3.0	
24/03/14	1730-1745	22/Cloudy	Surface	17.3	26.4	26.1	7.07	7.05	7.20	85.5	90.0		2.07	2.03		2.8	2.9	
			Middle	17.2	26.2	26.2	7.33	7.35	7.05	89.8	86.0	2.38	2.72	2.76	3.0	3.7	3.3	
			Bottom	17.1	26.2	26.3	7.37	7.02	6.93	90.2	83.8		2.79	2.35	3.6	3.4	3.3	
26/03/14	0815-0832	21/Fine	Surface	17.6	29.5	29.5	6.92	7.05	6.97	83.7	86.9		2.36	2.39		3.2	3.3	
			Middle	17.6	29.6	29.6	7.04	6.90	6.82	87.0	85.1	2.47	2.40	2.41	3.2	3.5	3.5	
			Bottom	17.5	29.5	29.6	6.89	6.82	6.82	85.0	84.1		2.41	2.63	3.4	3.4	3.7	
28/03/14	0930-0945	23/Cloudy	Surface	19.0	27.1	27.1	6.81	7.07	7.00	84.1	88.7		2.62	2.31		3.6	3.3	
			Middle	18.8	26.9	26.9	7.05	6.94	6.93	88.8	87.0	2.44	2.30	2.42	3.4	3.5	3.5	
			Bottom	18.6	26.8	26.8	6.92	6.79	6.79	87.1	85.2		2.43	2.60	3.6	3.7	3.7	
31/03/14	1130-1151	23/Rainy	Surface	18.2	26.3	26.4	6.78	7.15	7.08	85.1	86.9		2.61	3.03		4.2	4.1	
			Middle	18.7	26.5	27.6	7.19	7.17	6.99	86.6	84.7	2.88	3.03	2.73	4.0	3.7	3.9	
			Bottom	18.6	27.7	28.1	7.01	6.99	6.66	87.1	80.7		2.71	2.89	3.6	3.8	3.9	

**Mid-Ebb Tide**

**Monitoring Station : TKO-M4**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	
03/03/14	1440-1500	18/Cloudy	Surface	17.2	29.2	7.17	7.15	93.7	93.5	2.44	2.41	3.2	3.4	3.7				
				17.4	29.2	7.13	7.00	93.2	91.4	2.38	2.53	3.6	3.7					
			Middle	17.4	29.3	6.98	7.00	91.6	91.2	2.50	2.56	3.6	3.7					
				17.4	29.3	6.98	7.00	91.2	91.2	2.56	2.56	3.8	3.7					
			Bottom	17.4	29.4	7.18	7.17	93.8	93.8	2.70	2.72	4.0	4.0					
				17.4	29.5	7.16	7.17	93.7	93.7	2.74	2.74	4.0	4.0					
05/03/14	1610-1630	17/Cloudy	Surface	17.3	28.9	7.33	7.36	95.9	96.3	2.94	2.93	4.0	4.0	4.1				
				17.4	28.9	7.39	7.03	96.7	92.0	2.91	3.09	4.0	4.1					
			Middle	17.4	29.0	7.06	7.03	92.4	91.6	3.08	3.09	4.0	4.1					
				17.4	29.0	7.00	7.03	91.6	91.9	3.09	3.12	4.2	4.1					
			Bottom	17.4	29.0	7.04	7.03	92.1	91.7	3.13	3.10	4.2	4.1					
				17.4	29.0	7.01	7.03	91.7	91.7	3.10	3.10	4.0	4.0					
07/03/14	1710-1730	17/Cloudy	Surface	17.4	29.4	7.11	7.13	92.9	93.1	2.30	2.27	3.2	3.4	3.5				
				17.6	29.2	7.14	7.06	93.2	92.2	2.24	2.42	3.6	3.7					
			Middle	17.6	29.5	7.06	7.06	92.2	92.1	2.41	2.42	3.6	3.7					
				17.5	29.8	7.05	7.12	92.1	93.0	2.42	2.68	3.8	3.5					
			Bottom	17.5	29.7	7.11	7.12	92.9	93.1	2.66	2.68	3.4	3.5					
				17.5	29.6	7.13	7.12	93.1	93.1	2.69	2.68	3.4	3.5					
10/03/14	2040-2100	17/Cloudy	Surface	17.4	29.6	7.15	7.11	87.1	86.6	2.50	2.51	3.4	3.5	3.6				
				17.5	29.6	7.07	6.93	86.1	84.4	2.52	2.55	3.6	3.5					
			Middle	17.5	29.6	6.90	6.93	84.0	84.7	2.55	2.55	3.6	3.5					
				17.6	29.8	6.95	7.01	84.7	85.1	2.54	2.62	3.4	3.7					
			Bottom	17.6	29.7	6.99	7.01	85.1	85.3	2.62	2.62	3.8	3.7					
				17.6	29.8	7.02	7.10	85.5	85.3	2.61	2.62	3.6	3.7					
12/03/14	1042-1100	18/Cloudy	Surface	17.5	29.4	7.09	7.10	92.9	93.0	2.37	2.39	3.2	3.4	3.6				
				17.6	29.4	7.10	7.02	93.0	92.0	2.40	2.49	3.6	3.7					
			Middle	17.6	29.4	7.01	7.02	91.9	92.0	2.48	2.49	3.6	3.7					
				17.6	29.4	7.02	6.90	92.0	90.5	2.49	2.55	3.8	3.8					
			Bottom	17.6	29.5	6.91	6.90	90.6	90.3	2.56	2.55	3.6	3.8					
				17.6	29.5	6.89	7.41	90.3	90.3	2.54	2.55	4.0	4.0					
14/03/14	1138-1200	18/Cloudy	Surface	17.4	29.3	7.40	7.41	91.6	91.7	2.28	2.30	3.2	3.2	3.5				
				17.4	29.4	7.41	7.33	91.7	90.7	2.31	2.40	3.2	3.6					
			Middle	17.4	29.5	7.32	7.33	90.6	90.7	2.39	2.40	3.6	3.6					
				17.6	29.4	7.33	7.21	90.7	89.3	2.40	2.47	3.6	3.8					
			Bottom	17.6	29.5	7.22	7.21	89.3	89.2	2.47	2.46	3.6	3.8					
				17.6	29.6	7.20	7.03	89.1	87.1	2.45	3.06	4.0	4.0					
17/03/14	1410-1430	19/Cloudy	Surface	17.4	29.4	7.04	7.03	87.2	87.1	3.03	3.06	4.0	4.0	4.0				
				17.4	29.4	7.01	6.82	86.9	84.6	3.09	2.82	4.0	4.0					
			Middle	17.4	29.4	6.80	6.98	84.3	86.3	2.81	2.96	4.0	4.1					
				17.5	29.4	6.84	6.98	84.8	86.6	2.83	2.97	4.0	4.1					
			Bottom	17.5	29.5	6.96	6.98	86.3	85.6	2.95	2.03	4.2	4.1					
				17.5	29.5	6.99	7.05	86.6	85.2	2.97	2.05	4.0	4.1					
19/03/14	1510-1530	24/Cloudy	Surface	16.9	26.1	7.07	7.06	85.6	85.2	2.06	2.05	3.2	3.2	3.4				
				16.8	26.2	7.03	6.95	84.8	83.8	2.03	2.18	3.2	3.3					
			Middle	16.8	26.3	6.99	6.95	84.3	83.3	2.17	2.19	3.2	3.3					
				16.7	26.3	6.91	7.06	83.3	85.4	2.19	2.54	3.4	3.6					
			Bottom	16.7	26.2	7.08	7.06	85.4	84.9	2.54	2.56	3.6	3.8					
				16.7	26.2	7.04	7.06	84.9	84.9	2.58	2.56	4.0	4.0					

**Mid-Ebb Tide**

**Monitoring Station : TKO-M4**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average
21/03/14	1610-1630	21/Cloudy	Surface	1.0	16.9	26.2	26.2	7.10	7.08	86.1	85.7	2.01	2.02	3.2	3.2	2.23	3.4	3.6	3.6
			Middle	4.2	16.8	26.1	26.3	7.06	6.93	85.2	83.8	2.03	2.14	3.2	3.3				
			Bottom	7.4	16.8	26.3	26.5	6.94	7.11	83.8	85.8	2.16	2.51	3.4	3.6				
24/03/14	1910-1930	22/Cloudy	Surface	1.0	17.2	26.2	26.2	7.29	7.26	85.6	87.5	2.55	2.81	3.8	3.9	3.00	4.0	4.0	4.0
			Middle	4.2	17.2	26.2	26.2	7.23	6.97	89.3	85.0	2.81	2.99	4.0	3.9				
			Bottom	7.4	17.1	26.2	26.3	6.96	6.87	85.0	82.7	2.94	3.27	4.2	4.1				
26/03/14	0944-1000	21/Fine	Surface	1.0	17.6	29.5	29.5	7.14	7.13	88.1	88.0	2.33	2.35	3.2	3.4	2.49	3.7	3.8	3.9
			Middle	4.2	17.7	29.4	29.6	7.12	7.04	87.8	86.9	2.36	2.48	3.6	3.7				
			Bottom	7.4	17.7	29.6	29.6	7.06	6.94	87.1	85.6	2.50	2.65	3.8	3.9				
28/03/14	1115-1130	23/Cloudy	Surface	1.0	19.1	27.1	27.1	7.13	7.14	85.4	89.6	2.64	2.37	3.4	3.3	2.51	3.6	3.8	3.9
			Middle	4.2	19.0	27.0	26.9	7.15	7.01	89.7	88.0	2.36	2.55	3.2	3.7				
			Bottom	7.4	18.9	26.8	27.0	7.00	6.87	85.7	86.3	2.38	2.64	3.8	3.9				
31/03/14	1312-1330	23/Rainy	Surface	1.0	18.4	26.7	26.8	6.86	7.04	86.1	85.2	2.62	3.01	4.0	4.0	2.94	3.8	3.8	3.9
			Middle	4.4	18.5	26.8	27.4	7.01	6.99	86.4	84.6	3.01	2.84	4.0	3.8				
			Bottom	7.8	18.7	27.3	28.2	7.01	6.84	84.3	82.9	2.83	2.98	3.6	3.9				






## Appendix I

### D3


## Graphical Plots of Impact Marine Water Quality Monitoring Data



### Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

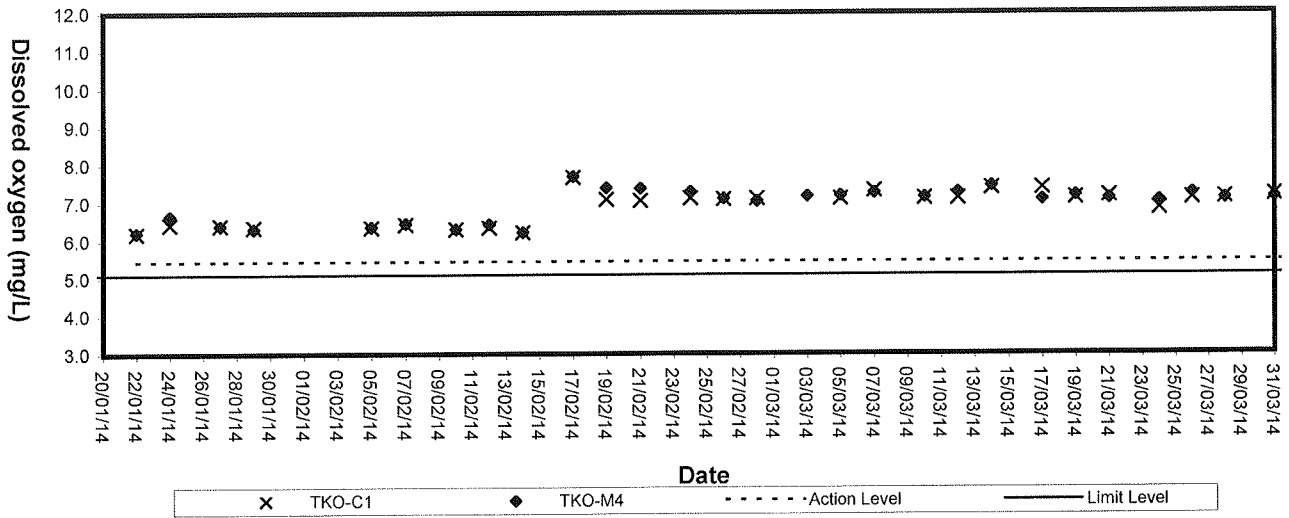


### Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

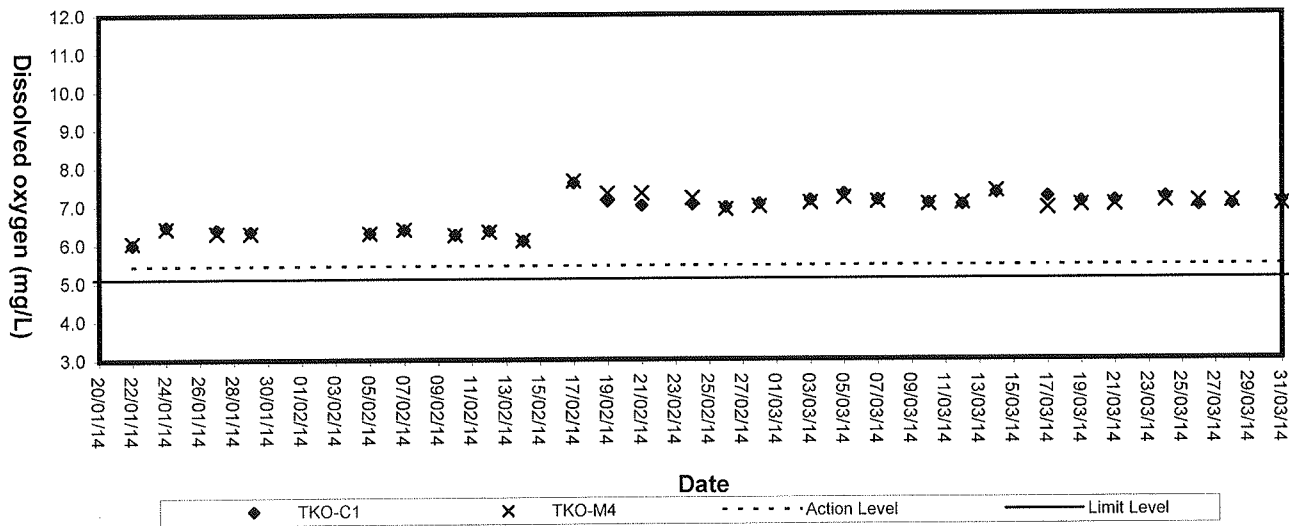




### Dissolved Oxygen (Bottom) at Mid-Flood Tide

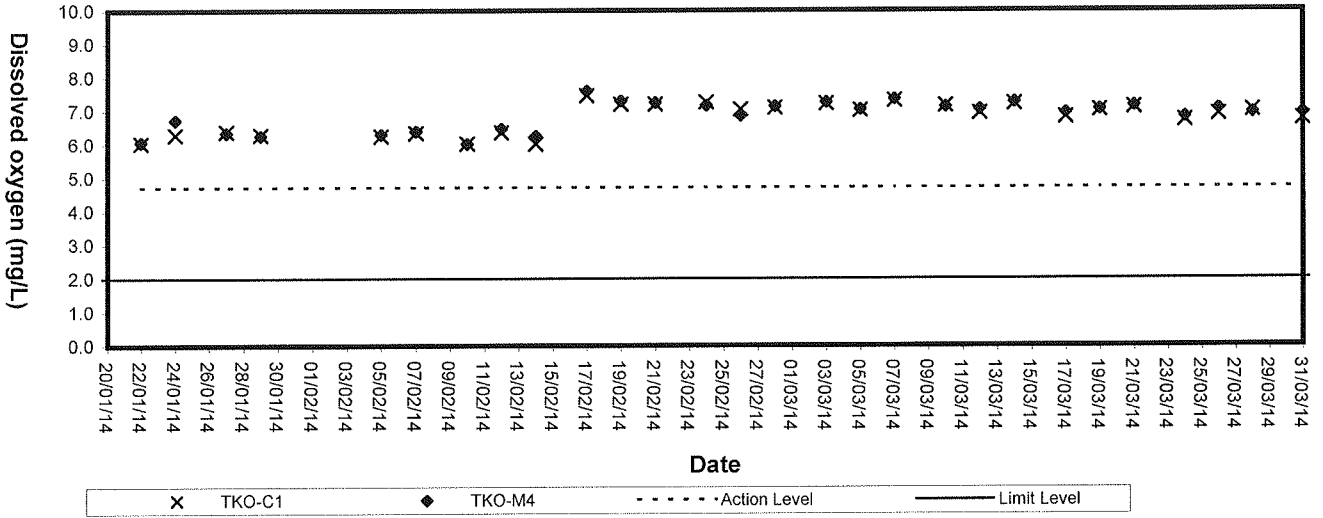


### Dissolved Oxygen (Bottom) at Mid-Ebb Tide

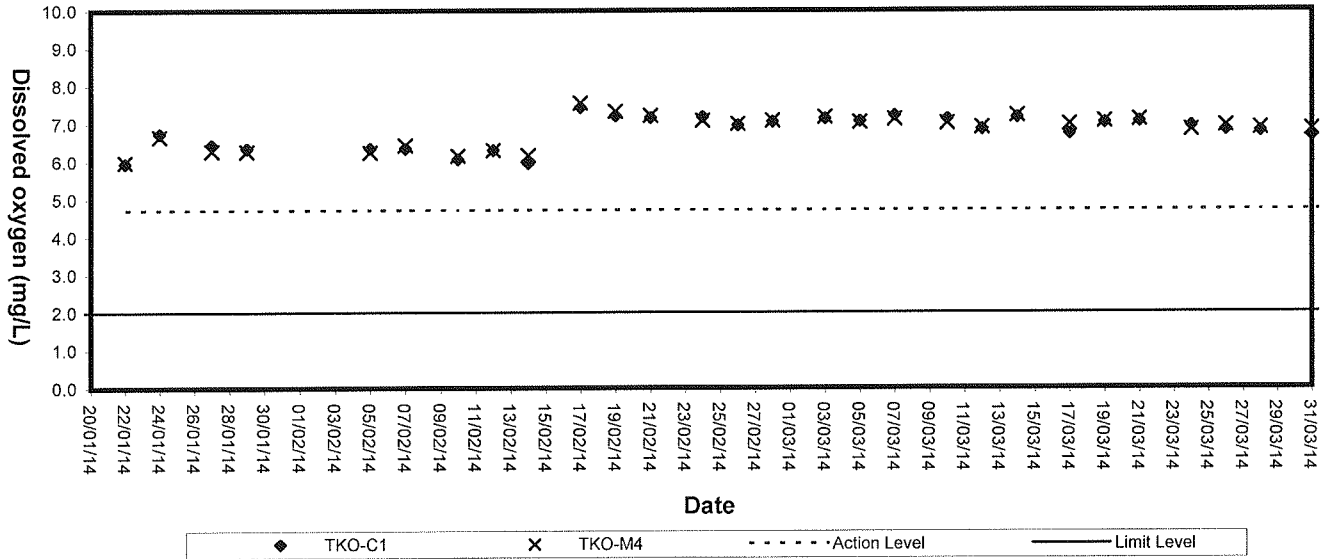




### Turbidity (Depth-average) at Mid-Flood Tide

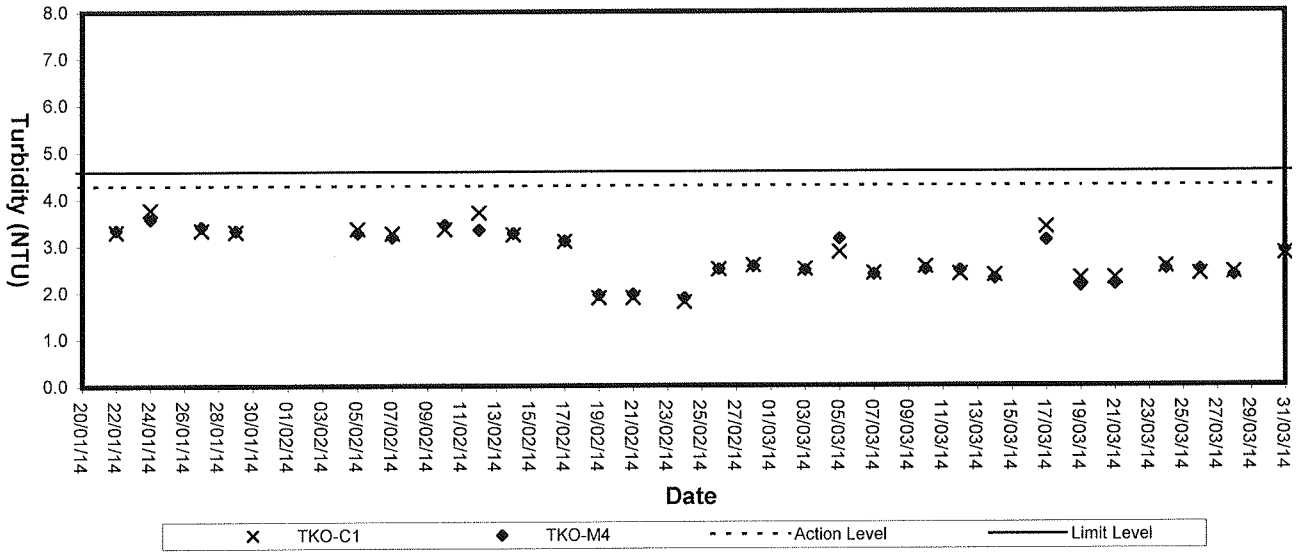


### Turbidity (Depth-average) at Mid-Ebb Tide

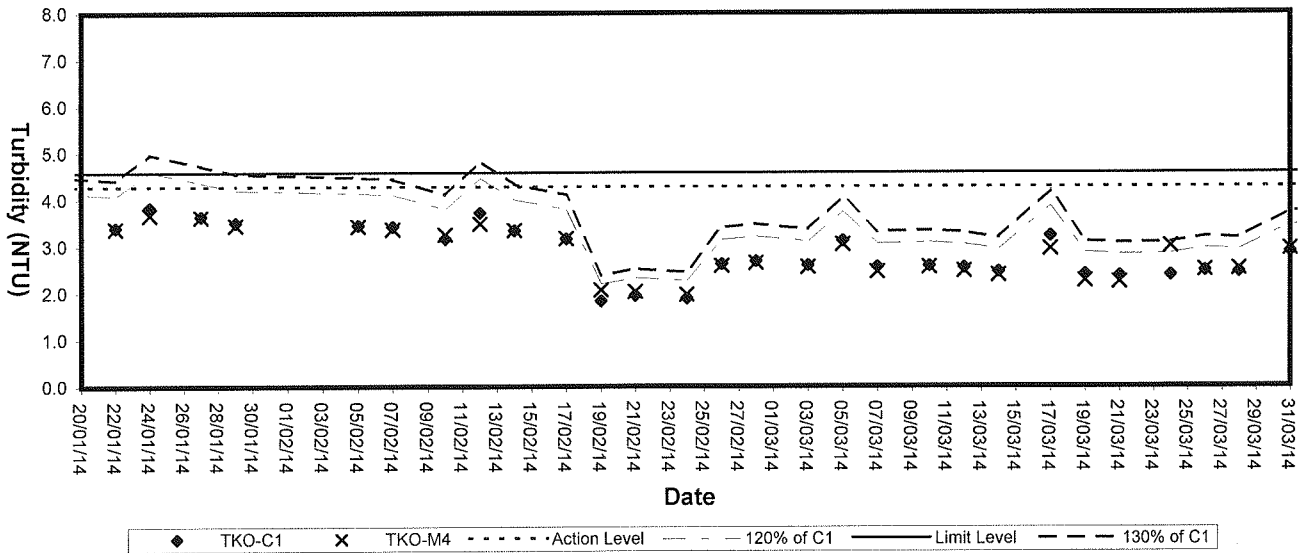




### Suspended solids (Depth-average) at Mid-Flood Tide

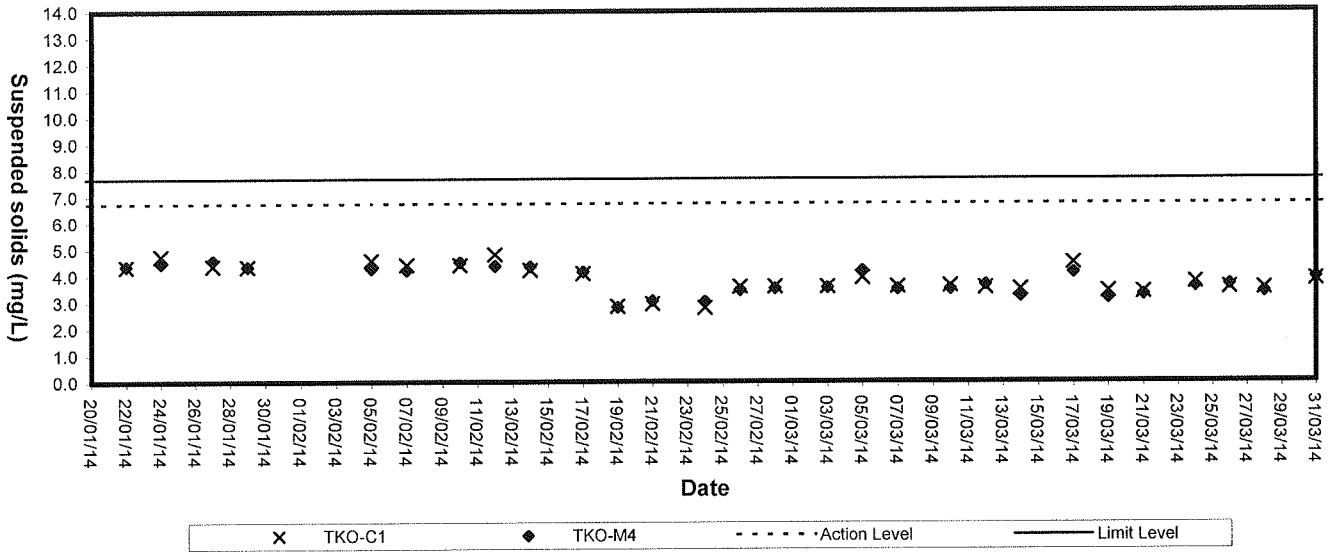

### Suspended Solids (Depth-average) at Mid-Ebb Tide

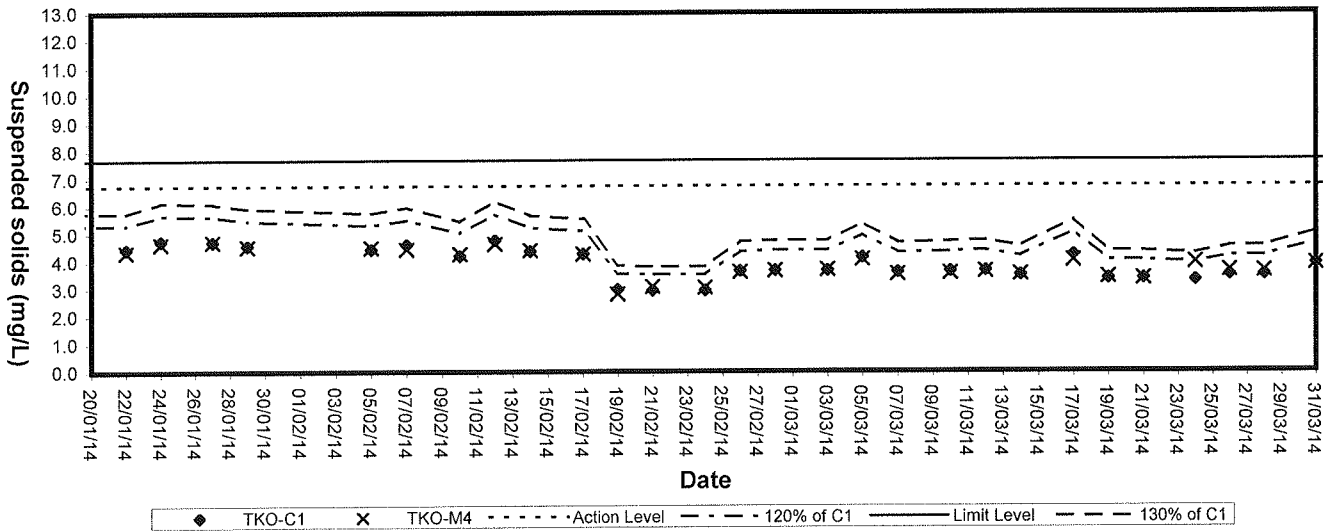



## **Appendix I**

### **E**

#### **Weather Condition**

## Extract of Meteorological Observations for Tseung Kwan O Automatic Weather Station, March 2014

Date	Mean Pressure at M.S.L. (hPa)	Air Temperature			Mean Dew Point Temperature (deg C)	Relative Humidity		
		Max. (deg C)	Mean (deg C)	Min. (deg C)		Max. (%)	Mean (%)	Min. (%)
Mar 1	*****	21.9	19.2	17.5	17.2	98	89	80
Mar 2	*****	22.3	17.6	14.0	16.4	100	93	65
Mar 3	*****	14.9	14.4	13.6	13.3	99	94	83
Mar 4	*****	17.5	15.7	14.1	14.7	99	94	85
Mar 5	*****	16.6	15.6	14.9	13.3	100	87	74
Mar 6	*****	15.1	14.1	13.4	12.6	98	90	78
Mar 7	*****	14.3	13.6	12.9	12.0	99	90	84
Mar 8	*****	14.6	13.9	13.3	13.4	99	97	89
Mar 9	*****	14.4	13.4	12.8	11.4	98	87	78
Mar 10	*****	14.1	13.4	12.8	10.1	89	81	66
Mar 11	*****	14.8	14.2	13.5	12.0	99	87	78
Mar 12	*****	18.3	16.6	14.5	16.4	100	99	96
Mar 13	*****	22.2	19.5	17.8	14.8	100	76	56
Mar 14	*****	19.3	15.9	13.0	11.3	91	75	45
Mar 15	*****	16.5	14.6#	12.6	9.5#	97	73#	46
Mar 16	*****	18.6	18.1#	17.4	12.8#	89	72#	52
Mar 17	*****	22.7	19.7	17.4	17.8	97	89	75
Mar 18	*****	25.7	21.3	19.1	19.5	99	90	71
Mar 19	*****	26.2	21.4	18.0	19.5	99	90	70
Mar 20	*****	25.1	20.4	16.5	16.5	100	80	60
Mar 21	*****	16.7	15.2	14.2	8.8	75	66	58
Mar 22	*****	19.8	16.3	14.0	9.2	81	65	41
Mar 23	*****	20.9	17.3	14.6	11.4	86	69	45
Mar 24	*****	22.9	18.4	14.8	13.1	92	72	47
Mar 25	*****	26.8	20.6	16.7	15.2	96	74	45
Mar 26	*****	27.3	21.7	17.8	18.6	98	84	60
Mar 27	*****	28.1	22.5	18.1	19.5	99	84	57
Mar 28	*****	21.9	20.8	19.7	20.1	99	96	91
Mar 29	*****	22.6	21.0	19.8	20.6	100	98	92
Mar 30	*****	23.1	21.0	18.5	20.7	100	98	90
Mar 31	*****	20.6	19.4	18.4	19.2	100	99	97
<b>Mean</b>	*****	20.2	17.7#	15.7	15.0#	96	85#	69
<b>Maximum</b>	*****	28.1	22.5#	19.8	20.7#	100	99#	97
<b>Minimum</b>	*****	14.1	13.4#	12.6	8.8#	75	65#	41

## Extract of Meteorological Observations for Tseung Kwan O Automatic Weather Station, March 2014

Date	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
Mar 1	0.0	080	3.8
Mar 2	6.0	020	6.1
Mar 3	1.5	020	7.8
Mar 4	0.5	070	4.9
Mar 5	0.0	070	6.3
Mar 6	2.0	040	9.1
Mar 7	1.5	050	8.4
Mar 8	1.5	060	6.0
Mar 9	0.0	070	6.3
Mar 10	0.5	050	9.4
Mar 11	1.5	020	7.5
Mar 12	0.5	030	3.1
Mar 13	0.5	060	6.3
Mar 14	1.0	030	7.0
Mar 15	0.0#	030#	6.7#
Mar 16	0.0#	050#	5.4#
Mar 17	0.0	080	3.7
Mar 18	0.0	080	4.3
Mar 19	0.0	190	3.2
Mar 20	0.0	060	5.0
Mar 21	0.0	360	6.5
Mar 22	0.0	020	8.5
Mar 23	0.0	030	10.4
Mar 24	0.0	020	7.1
Mar 25	0.0	060	4.2
Mar 26	0.0	180	3.7
Mar 27	0.0	190	4.7
Mar 28	0.0	020	4.3
Mar 29	16.0	190	2.9
Mar 30	106.0	030#	3.3#
Mar 31	82.0	***	*****
<b>Mean</b>	-----	030#	5.9#
<b>Total</b>	221.0#	---	-----
<b>Maximum</b>	106.0#	---	10.4#
<b>Minimum</b>	0.0#	---	2.9#

\*\*\* unavailable

# missing (less than 24 hourly observations a day)

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected





## **Appendix I**

### **F**

## **Event-Action Plans**

## EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

	ACTION			
EVENT	ET Leader	IC(E)	ER	Contractor
<b>ACTION LEVEL</b>				
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Inform ER, IC(E) and Contractor</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET</li> <li>2. Check contractor's working method</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify Contractor</li> </ol>	<ol style="list-style-type: none"> <li>1. Rectify any unacceptable practise</li> <li>2. Amend working methods if appropriate</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Inform IC(E) and Contractor</li> <li>3. Repeat measurements to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Discuss with IC(E) and Contractor on remedial actions</li> <li>6. If exceedance continues, arrange meeting with IC(E) and ER.</li> <li>7. If exceedance stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET</li> <li>2. Check the Contractor's working method</li> <li>3. Discuss with ET and Contractor on possible remedial measures</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures</li> <li>5. Supervise implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify the Contractor</li> <li>3. Ensure remedial measures properly implemented</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>2. Implement the agreed proposals</li> <li>3. Amend proposal if appropriate</li> </ol>
<b>LIMIT LEVEL</b>				
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Inform ER, Contractor and EPD</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET</li> <li>2. Check Contractor's working method</li> <li>3. Discuss with ET and Contractor on possible remedial measures</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures</li> <li>5. Supervise implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify the Contractor</li> <li>3. Ensure remedial measures properly implemented</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Amend proposal if appropriate.</li> </ol>

## EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ACTION			Contractor
	ET Leader	IC(E)	ER	
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify source, investigate the causes of exceedance and propose remedial measures</li> <li>2. Notify IC(E), ER, EPD and Contractor</li> <li>3. Repeat measurement to confirm finding</li> <li>4. Increase monitoring frequency to daily</li> <li>5. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented</li> <li>6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</li> <li>8. If exceedance stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET and Contractor on the potential remedial actions</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly</li> <li>3. Supervise the implementation of remedial measures</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing</li> <li>2. Notify Contractor</li> <li>3. In consultation with the IC(E), agree with the Contractor on the remedial measures to be implemented</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedances</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Resubmit proposals if problem still not under control</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedance is abated</li> </ol>

## EVENT/ACTION PLAN FOR NOISE EXCEEDANCE

EVENT	ACTION			
	ET Leader	IC(E)	ER	Contractor
Action Level	<ol style="list-style-type: none"> <li>1. Notify the IC(E) and the Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to the IC(E) and the Contractor.</li> <li>4. Discuss with the Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IC(E).</li> <li>2. Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol style="list-style-type: none"> <li>1. Notify the IC(E), the ER, the EPD and the Contractor.</li> <li>2. Identify source.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform the IC(E), the ER and the EPD the causes &amp; actions taken for the exceedances.</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results</li> <li>8. If exceedance due to the construction works stops, cease additional monitoring</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Resubmit proposals if problem still not under control.</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION		
	ET Leader	Contractor	ER
<p>Action level being exceeded by one sampling day</p>	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Repeat in-situ measurement to confirm findings;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days</li> <li>8. Repeat measurement on next day of exceedance if exceedance is due to the construction works</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify the ER and IEC in writing within 24 hours of identification of exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance</li> <li>5. Consider changes of working method if exceedance is due to the construction works</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the mitigation measure</li> </ol>
			<p>IEC</p> <ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures</li> <li>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>5. Supervise the implementation of mitigation measures</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY

Event	ACTION			IEC
	ET Leader	Contractor	ER	
<p>Action level being exceeded by more than one consecutive sampling days</p>	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Repeat in-situ measurement to confirm findings</li> <li>3. Notify Contractor in writing within 24 hours of identification</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Prepare to increase the monitoring frequency to daily;</li> <li>10. Repeat measurement on next day of exceedance.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify IEC and ER in writing within 24 hours of identification of exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Require contractor to propose remedial measures for the analysed problem if related to the construction works</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the mitigation measure</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION		
	ET Leader	Contractor	ER
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC, ER and Contractor within 4 working of identification of an exceedance</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Increase the monitoring frequency to daily until no exceedance of Limit Level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify IEC and ER in writing; within 24 hours of the identification of the exceedance</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance</li> <li>7. Implement the agreed mitigation measures within reasonable time scale</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to critically review the working methods;</li> <li>4. Ensure remedial measures are properly implemented</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>
			<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ET, ER and Contractor on the mitigation measures.</li> <li>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>5. Assess the effectiveness of the implemented mitigation measures</li> </ol>

## EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			
	ET Leader	Contractor	ER	IEC
Limit Level being exceeded by more than one consecutive sampling days	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Notify Contractor in writing within 24 hours of identification of the exceedance</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Carry out investigation</li> <li>6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works</li> <li>7. Discuss mitigation measures with IEC, ER and Contractor;</li> <li>8. Ensure mitigation measures are implemented;</li> <li>9. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify ER and IEC in writing within 24 hours of the identification of the exceedance and</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Consider changes of working methods;</li> <li>8. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance</li> <li>5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days;</li> <li>6. Implement the agreed mitigation measures within reasonable time scale</li> <li>7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance</li> <li>2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to critically review the working methods;</li> <li>6. Ensure remedial measures are properly implemented</li> <li>4. Assess the effectiveness of the implemented mitigation measures;</li> <li>5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET</li> <li>2. Confirm ET assessment if exceedance is due / not due to the works</li> <li>3. Discuss with ER, ET and Contractor on the mitigation measures.</li> <li>4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly.</li> <li>5. Assess the effectiveness of the implemented mitigation measures.</li> </ol>





## **Appendix I**

### **G**

## **Works Programme**

Master Programme of Contract No. CV/2013/06 - Handling of Surplus Public Fill

Site Location : Tseung Kwan O Area 137 Fill Bank

ID	Activity	Original Duration	Start	Finish
A1150	Take Over	0	23-Jan-14	
A1170	Operation	1100	23-Jan-14	26-Jan-17
A1370	Hand Over to CEDD	0		26-Jan-17
Stage A1 Construction of New Office		120	28-Nov-13	27-May-14
A1080	Submission	30	28-Nov-13	27-Dec-13
A1090	Approval by Engineer	7	28-Dec-13	03-Jan-14
A1100	Installation	64	23-Jan-14	27-May-14
A1110	Hand Over to Engineer	0		27-May-14
Stage A1 Surveillance System		120	28-Nov-13	27-May-14
A1190	Submission	30	28-Nov-13	27-Dec-13
A1200	Approval by Engineer	7	28-Dec-13	03-Jan-14
A1210	Installation	64	23-Jan-14	27-May-14
A1230	Hand Over to Engineer	0		27-May-14






## **Appendix I**

### **H**

#### **Weekly ET's Site Inspection Record**

CEDD Contract No.: CV/2013/06  
 Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 5-3-14  
 Time : 10:00  
 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy  
 Wind : Calm / Light / Breeze / Strong  
 Temperature : 17  
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	C.K. Wong	Eric Jackie	Eric Jackie
Title	Acowps	EO - S.S	E.T



Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Implementation Stages*		Remark
<b>Fugitive Dust Emission</b>		
√		Dust control / mitigation measures shall be provided to prevent dust nuisance.
√		A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.
√		Water sprays shall be provided and used to dampen materials.
√		Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.
√		All vehicles shall be restrict to a maximum speed of 10 km per hour.
√		Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.
√		The designated site main haul road shall be paved or regular watering.
√		Frequent watering of work site shall be at least three times per day.
√		Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.
√		Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.
√		All plant and equipment should be well maintained e.g. without black smoke emission.
√		Open burning should be prohibited.
√		The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.
√		Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.
√		When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.
√		The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.
√		The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.
<b>Noise Impact</b>		
√		The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.
√		Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.
√		Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.
√		Air compressors and hand held breakers should have noise labels.
√		Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.
√		Noisy equipment and mobile plant shall always be site away from NSRs.



Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

		Implementation Stages*		Remark
		Yes	No N/A	
<b>Water Quality</b>				
▪	Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√		
▪	The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√		
▪	Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√		
▪	Manholes should be covered and sealed.	√		
▪	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√		
▪	A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√		
▪	A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√		
▪	The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√		
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
▪	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√		
▪	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√		
▪	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√		
▪	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√		
▪	Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√		
▪	Oil interceptor shall be provided at work shop.	√		
▪	Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√		
▪	The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√		
▪	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√		
▪	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√		
▪	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√		
▪	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√		
▪	Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√		Item 2 and 3
▪	A waste collection vessel shall be deployed to remove floating debris.	√		



Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank


		Implementation Stages*		Remark
		Yes	No / N/A	
<b>Environmental Checklist</b>				
<b>Landscaping and Visual</b>				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√		
<b>Other Environmental Factors</b>				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√		
▪	All generators, fuel and oil storage are within bundle areas.	√		
▪	Oil leakage from machinery, vehicle and plant is prevented.	√		
▪	The Environmental Permit should be displaced conspicuously on site.	√		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√		

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 4 on 26/02/14, new skirt curtain was provided for the generator near tipping hall No.2.	---	140305_001	No	---
2	The position of silt curtain near CEDD site office was found shifted.	To re-located the shifted silt curtain properly.	140305_002	Yes	12/03/14
3	The floating booms of silt curtain near the tipping hall No. 1 was found damaged.	To repair the damaged silt curtain properly.	140305_003	Yes	12/03/14



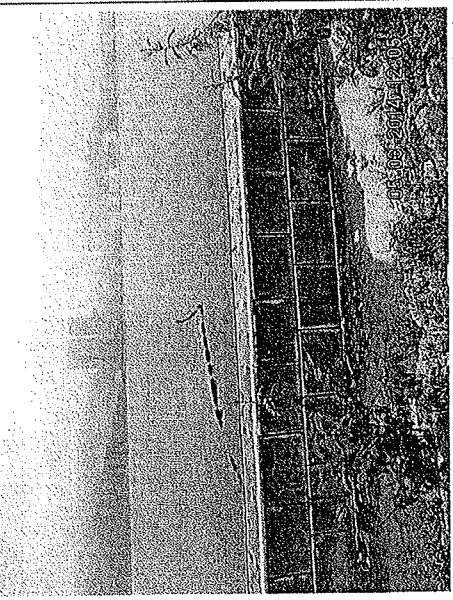
Remark

---
-----

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		05 March 2014



**Photos**

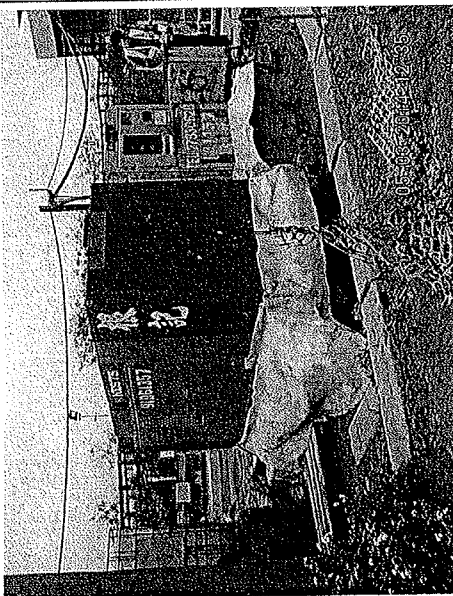


 <p>Photo 140305_001 (Near tipping hall No.2) (Improved)</p>	 <p>Photo 140305_002 (Silt curtain near CEDD site office)</p>	 <p>Photo 140305_003 (Silt curtain near tipping hall No.1)</p>	
---	---	---	--



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 12-3-14  
 Time : 10:00  
 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy  
 Wind : Calm / Light / Breeze / Strong  
 Temperature : 17  
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	C.K. Wong F. X. DA COSTA	Jackie Eric	Tung Ching Ho
Title	Asst/PS Ion/PS	SS ED	E.7



Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
<b>Fugitive Dust Emission</b>				
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.	√			
▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	√			
▪ Water sprays shall be provided and used to dampen materials.	√			
▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	√			
▪ All vehicles shall be restrict to a maximum speed of 10 km per hour.	√			
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	√			
▪ The designated site main haul road shall be paved or regular watering.	√			
▪ Frequent watering of work site shall be at least three times per day.	√			
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	√			
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√			
▪ All plant and equipment should be well maintained e.g. without black smoke emission.	√			
▪ Open burning should be prohibited.	√			
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√			
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√			
▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√			
▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	√			
▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√			
<b>Noise Impact</b>				
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	√			
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	√			
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√			
▪ Air compressors and hand held breakers should have noise labels.	√			
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	√			
▪ Noisy equipment and mobile plant shall always be site away from NSRs.	√			

Implementation Stages*		Remark
<b>Water Quality</b>		
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√	
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√	
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√	
Manholes should be covered and sealed.	√	
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√	
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√	
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√	
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√	
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√	
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√	
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√	
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√	
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√	
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√	
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√	
Oil interceptor shall be provided at work shop.	√	
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√	
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√	
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√	
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√	
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√	
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√	
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√	Item 2 and 3
A waste collection vessel shall be deployed to remove floating debris.	√	

Environmental Checklist	Implementation Stages*		Remark
	Yes	No / N/A	
<b>Landscape and Visual</b>			
<ul style="list-style-type: none"> <li>The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> </ul>	√		
<ul style="list-style-type: none"> <li>The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.</li> </ul>	√		
<ul style="list-style-type: none"> <li>Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> </ul>	√		
<ul style="list-style-type: none"> <li>The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	√		
<b>Other Environmental Factors</b>			
<ul style="list-style-type: none"> <li>C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> </ul>	√		
<ul style="list-style-type: none"> <li>Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.</li> </ul>	√		
<ul style="list-style-type: none"> <li>Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> </ul>	√		
<ul style="list-style-type: none"> <li>All generators, fuel and oil storage are within bundle areas.</li> </ul>	√		
<ul style="list-style-type: none"> <li>Oil leakage from machinery, vehicle and plant is prevented.</li> </ul>	√		
<ul style="list-style-type: none"> <li>The Environmental Permit should be displaced conspicuously on site.</li> </ul>	√		
<ul style="list-style-type: none"> <li>Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> </ul>	√		
<ul style="list-style-type: none"> <li>To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	√		



**Summary of the Weekly Site Inspection:**

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 2 on 05/03/14, the position of silt curtain near CEDD site office was still found shifted.	To re-located the shifted silt curtain properly.	140312_001	Yes	19/03/14
2	Follow up action to item 3 on 05/03/14, the floating booms of silt curtain near the tipping hall No.1 was still found damaged.	To repair the damaged silt curtain properly.	140312_002	Yes	19/03/14

Remark

---

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		12 March 2014



Photos

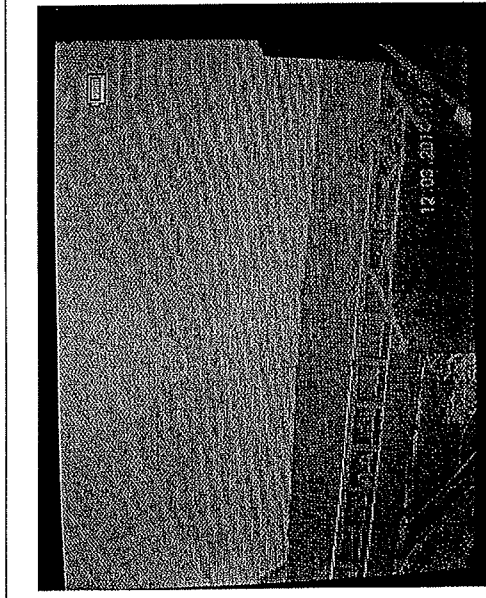


Photo 140312\_002 (Silt curtain near CEDD site office)



Photo 140312\_003 (Silt curtain near tipping hall No.1)



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 19/3/14




Time : 15:00

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 23°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	C. K. WOO F. S. DA COSTA	ERIC	Stark Sei Wai
Title	ACOWP3	CEO	E.T



Implementation Stages*		Remark
<b>Fugitive Dust Emission</b>		
√		Dust control / mitigation measures shall be provided to prevent dust nuisance.
√		A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.
√		Water sprays shall be provided and used to dampen materials.
√		Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.
√		All vehicles shall be restrict to a maximum speed of 10 km per hour.
√		Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.
√		The designated site main haul road shall be paved or regular watering.
√		Frequent watering of work site shall be at least three times per day.
√		Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.
√		Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.
√		All plant and equipment should be well maintained e.g. without black smoke emission.
√		Open burning should be prohibited.
√		The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.
√		Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.
√		When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.
√		The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.
√		The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.
<b>Noise Impact</b>		
√		The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.
√		Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.
√		Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.
√		Air compressors and hand held breakers should have noise labels.
√		Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.
√		Noisy equipment and mobile plant shall always be site away from NSRs.



Environmental Checklist		Implementation Stages*		Remark
		Yes	No	
<b>Water Quality</b>				
▪	Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√		
▪	The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√		
▪	Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√		
▪	Manholes should be covered and sealed.	√		
▪	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√		
▪	A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√		
▪	A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafloor.	√		
▪	The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√		
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
▪	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√		
▪	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√		
▪	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√		
▪	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√		
▪	Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√		
▪	Oil interceptor shall be provided at work shop.	√		
▪	Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√	Item 4	
▪	The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√		
▪	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√		
▪	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√		
▪	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√		
▪	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√		
▪	Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√	Item 1 and 2	
▪	A waste collection vessel shall be deployed to remove floating debris.	√		



Environmental Checklist		Implementation Stages*		Remark
		Yes	No	
<b>Landscape and Visual</b>				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√		
<b>Other Environmental Factors</b>				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√		
▪	All generators, fuel and oil storage are within bundle areas.	√		
▪	Oil leakage from machinery, vehicle and plant is prevented.	√		Item 3
▪	The Environmental Permit should be displaced conspicuously on site.	√		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√		



**Summary of the Weekly Site Inspection:**

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 2 on 05/03/14 and item 1 on 12/03/14, the position of silt curtain near CEDD site office was still found shifted.	To re-located the shifted silt curtain properly.	140319_001	Yes	26/03/14
2	Follow up action to item 3 on 05/03/14 and item 2 on 12/03/14, the floating booms of silt curtain near the tipping hall No. 1 was still found damaged.	To repair the damaged silt curtain properly.	140319_002	Yes	26/03/14
3	Oil stain was noted from a generator at CREO.	To clean up the oil stain and treat the contaminated material as chemical waste, and check / repair the generator to avoid oil leakage.	140319_003	Yes	26/03/14
4	The enclosure of tipping hall No.3 was found damaged.	To repair the damaged parts of tipping hall properly.	140319_004	Yes	26/03/14

Remark

--

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		19 March 2014

Photos

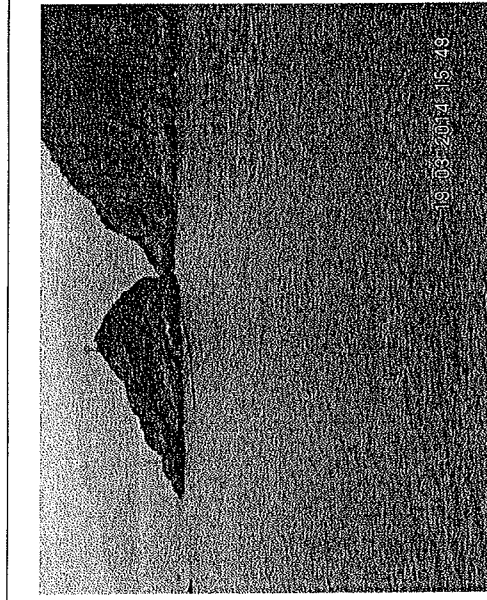


Photo 140319\_002 (Silt curtain near CEDD site office)

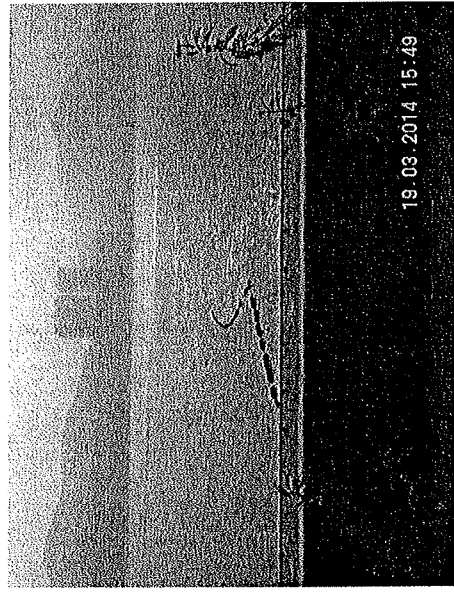


Photo 140319\_003 (Silt curtain near tipping hall No.1)



Photo 140319\_003 (CREO)



Photo 140319\_004 (Tipping hall No.3)



Inspection Date : 26/3/14

Time : 10:30

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 23°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	F. X. PAWATA S.H. Cheung	Jerry Sim, Jackie Ho, EMC	Mak Sei Wai
Title	Job/P3 AZOW/P3	EO	E.T

Environmental Checklist	Implementation Stages*		Remark
	Yes	No / N/A	
<b>Fugitive Dust Emission</b>			
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.	✓		
▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	✓		
▪ Water sprays shall be provided and used to dampen materials.	✓		
▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	✓		
▪ All vehicles shall be restricted to a maximum speed of 10 km per hour.	✓		
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	✓		
▪ The designated site main haul road shall be paved or regular watering.	✓		
▪ Frequent watering of work site shall be at least three times per day.	✓		
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	✓		
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	✓		
▪ All plant and equipment should be well maintained e.g. without black smoke emission.	✓		
▪ Open burning should be prohibited.	✓		
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	✓		
▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	✓		
▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	✓		
<b>Noise Impact</b>			
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	✓		
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	✓		
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	✓		
▪ Air compressors and hand held breakers should have noise labels.	✓		
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	✓		
▪ Noisy equipment and mobile plant shall always be site away from NSRs.	✓		



Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Environmental Checklist		Implementation Stages*		Remark
		Yes	No / N/A	
<b>Water Quality</b>				
<input checked="" type="checkbox"/>	Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	<input checked="" type="checkbox"/>		Item 5
<input checked="" type="checkbox"/>	The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Manholes should be covered and sealed.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Oil interceptor shall be provided at work shop.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	<input checked="" type="checkbox"/>		
<input checked="" type="checkbox"/>	Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	<input checked="" type="checkbox"/>		Item 1
<input checked="" type="checkbox"/>	A waste collection vessel shall be deployed to remove floating debris.	<input checked="" type="checkbox"/>		





Environmental Checklist		Implementation Stages*			Remark
		Yes	No	N/A	
<b>Landscaping and Visual</b>					
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√			
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√			
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√			
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√			
<b>Other Environmental Factors</b>					
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√			
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√			
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√			
▪	All generators, fuel and oil storage are within bundle areas.	√			
▪	Oil leakage from machinery, vehicle and plant is prevented.	√			
▪	The Environmental Permit should be displaced conspicuously on site.	√			
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√			
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√			



Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 2 on 05/03/14 and item 1 on 12/03/14 and item 1 on 19/03/14, the position of silt curtain near CEDD site office was still found shifted.	To re-located the shifted silt curtain properly.	140326_001	Yes	02/04/14
2	Follow up action to item 3 on 05/03/14 and item 2 on 12/03/14 and item 2 on 19/03/14, the floating booms of silt curtain near the tipping hall No. 1 was repaired.	---	140326_002	No	---
3	Follow up action to item 3 on 19/03/14, oil stain from a generator at CREO was cleaned up.	---	140326_003	No	---
4	Follow up action to item 4 on 19/03/14, the enclosure of tipping hall No.3 was repaired.	---	140326_004	No	---
5	Mud and silt were found accumulated inside the drainage near the entrance of sorting facilities.	To clear the accumulated mud and silt inside the drainage.	140326_005	Yes	02/04/14

Remark

---

	Name	Title	Signature	Date
Checked by	Linda Law	Senior Environmental Officer	<i>Linda Law</i>	26 March 2014

Photos

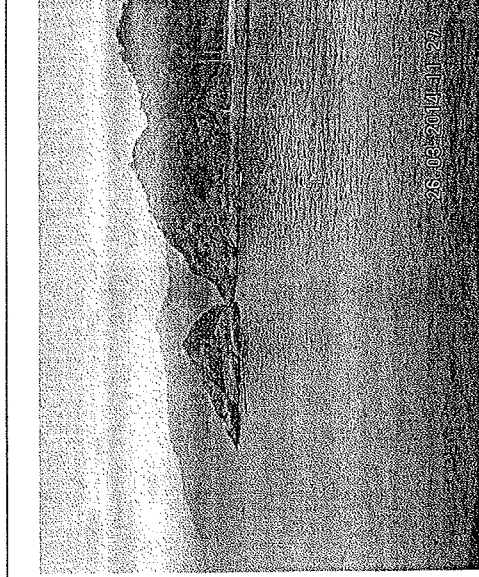


Photo 140326\_002 (Silt curtain near CEDD site office)

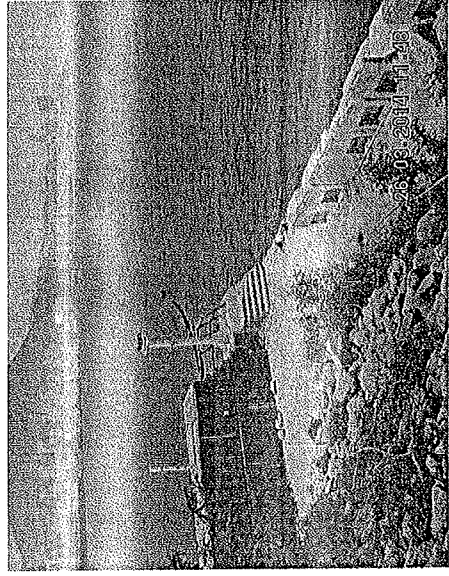


Photo 140326\_003 (Silt curtain near tipping hall No.1) (Improved)



Photo 140326\_003 (CREO) (Improved)

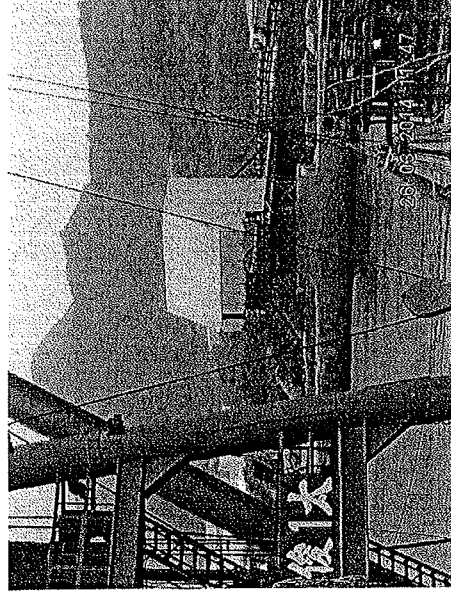


Photo 140326\_004 (Tipping hall No.3) (Improved)

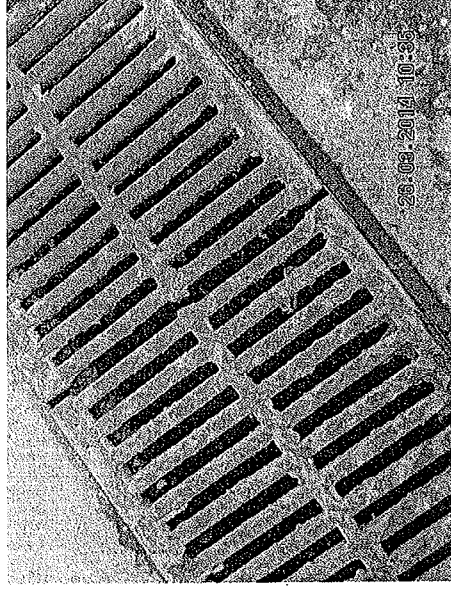


Photo 140326\_005 (Near the entrance of sorting facilities)



## **Appendix I**

### **I**

## **Implementation Schedule of Mitigation Measures**



## Environmental Mitigation Implementation Schedule

	Location	Implementation Status				
		Implemented	Partially implemented	Not implemented Not Applicable		
<b>Environmental Protection Measures</b>						
<b>Air Quality</b>						
<ul style="list-style-type: none"> <li>▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.</li> <li>▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.</li> <li>▪ Water sprays shall be provided and used to dampen materials.</li> <li>▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.</li> <li>▪ All vehicles shall be restrict to a maximum speed of 10 km per hour.</li> <li>▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.</li> <li>▪ The designated site main haul rout shall be paved or regular watering.</li> <li>▪ Frequent watering of work site shall be at least three times per day.</li> <li>▪ Wheel washing facilities including high pressure water jet shall be provided at the entrance of work site.</li> <li>▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.</li> <li>▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> <li>▪ Final slope surfaces, especially those facing to the north of the site shall be treated by hydroseeding, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> <li>▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.</li> <li>▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.</li> <li>▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.</li> <li>▪ All plant and equipment should be well maintained e.g. without black smoke emission.</li> </ul>						
<b>Noise Impact</b>						
<ul style="list-style-type: none"> <li>▪ Approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.</li> <li>▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the site works.</li> <li>▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.</li> <li>▪ Air compressors and hand held breakers should have noise labels.</li> <li>▪ Machines and plants that may be in intermittent use should be shut down between work months or should be throttled down to a minimum.</li> <li>▪ Noisy equipment and mobile plant shall always be site away from NSRs.</li> </ul>						



Handling of Surplus Public Fill – Tseung Kwan O Area 137 Fill Bank  
Contract No.: CV/2009/02

	Environmental Protection Measures	Location	Implementation Status			
			Implemented	Partially implemented	Not implemented	Not Applicable
<b>Water Quality</b>						
■	Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	All areas	✓			
■	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	All areas	✓			
■	The existing / realigned intercepting channels and the sand / silt removal facilities shall be used and maintained regularly.	All areas	✓			
■	Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the month shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank.	Along the seafont		✓		
■	A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafont.	C&DMSF	✓			
■	The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	All areas	✓			
■	The material shall be properly covered to prevent washed away especially before rainstorm.	All areas	✓			
■	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	Temporary Slopes	✓			
■	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	Wheel Washing facility	✓			
■	Obtain Discharge License	Site Office	✓			
■	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	Barge Handling Area (BHA)	✓			
■	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	Barge Handling Area (BHA)	✓			
■	A waste collection vessel shall be deployed to remove floating debris.	Barge Handling Area (BHA)	✓			
<b>Landscape and Visual</b>						
●	Construction of lighting to avoid spillage and glare	All areas	✓			
●	Hydro-seeding	Completed slopes	✓			
●	Hoarding erection	Site boundary	✓			
●	Damage to surrounding area avoided	All areas	✓			
<b>Other Environmental Factors</b>						
●	C&D waste sorted from mixed C&D material shall be transfer to SENT landfill for disposal.	All areas	✓			
●	Plan and stock construction materials carefully to minimise generation of waste.	All areas	✓			
●	Any unused materials or those with remaining functional capacity should be recycled.	All areas	✓			
●	All generators, fuel and oil storage are within bunded areas.	All areas	✓			
●	Oil leakage from machinery, vehicle and plant is prevented.	All areas		✓		
●	The Environmental Permit should be displaced conspicuously on site.	All areas	✓			
●	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	All areas	✓			
●	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	All areas	✓			



## Appendix I

### J

## Site General Layout plan

- NOTES:
- 1. ALL DIMENSIONS REFER TO WORKING SURFACE UNLESS OTHERWISE SPECIFIED IN METRES.
  - 2. DIMENSIONS IN METRES.
  - 3. ALL DIMENSIONS ARE IN METRES.
  - 4. EXISTING BASE MARKING AREA PAINTED SURFACING REFER TO DRAWING NO. AT14K SURFACING.
  - 5. EXISTING DRAINAGE CHANNELS AND OUTFALLS REFER TO DRAWING NO. EPO1001-14.
  - 6. THE CONTRACTOR SHALL VERIFY THE EXISTING UTILITY NETWORK (SPECIAL CONDUIT) AT THE TIME WITH THE CONTRACTOR TO OBTAIN POSSESSION OF THE SITE.

LEGEND:

---	SITE BOUNDARY
-·-·-	EXISTING BASE MARKING AREA
X	EXISTING INVOLUTION LIGHT
⊠	BUFFER ZONE
———	EXISTING CONCRETE ACCESS ROAD
-·-·-	EXISTING FENCING
---	PORTION BOUNDARY (RECTANGULAR ONLY)
⊠	EXISTING SIGNPOST POINT AT WITH 2 BOUNDARIES

ABBREVIATION:

V.A.R. OBELISK MARKING BAY  
V.A.F.P. OBELISK MARKING FACILITY

NO.	DATE	REVISION	BY	CHKD.	APPD.
1	28/10/16	ISSUED FOR TENDER	P. J. LUI	S. M. CHAN	28/10/16
2	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
3	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
4	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
5	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
6	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
7	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
8	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
9	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16
10	29/10/16	REVISION	F. A. YU	S. M. CHAN	29/10/16

DESIGNED BY: P. J. LUI  
DRAWN BY: F. A. YU  
CHECKED BY: S. M. CHAN  
APPROVED BY: S. M. CHAN

DATE: 29/10/16

CONTRACT NO.: EY/2012/05  
SITE NO.:  
PROJECT NO.:  
CONTRACTOR:

**HANDLING OF SURPLUS PUBLIC FILL (2014-2016)**

**TSEUNG KWAN O AREA 137 FILL BANK GENERAL LAYOUT OF EXISTING FACILITIES**


DRAWING TITLE

DRAWING NO: FMI0068-6  
SCALE: 1:200 AS SHOWN

OFFICE: FILL MANAGEMENT DIVISION CIVIL ENGINEERING OFFICE

CEDD CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT

847000E  
845500E  
845000E  
844500E

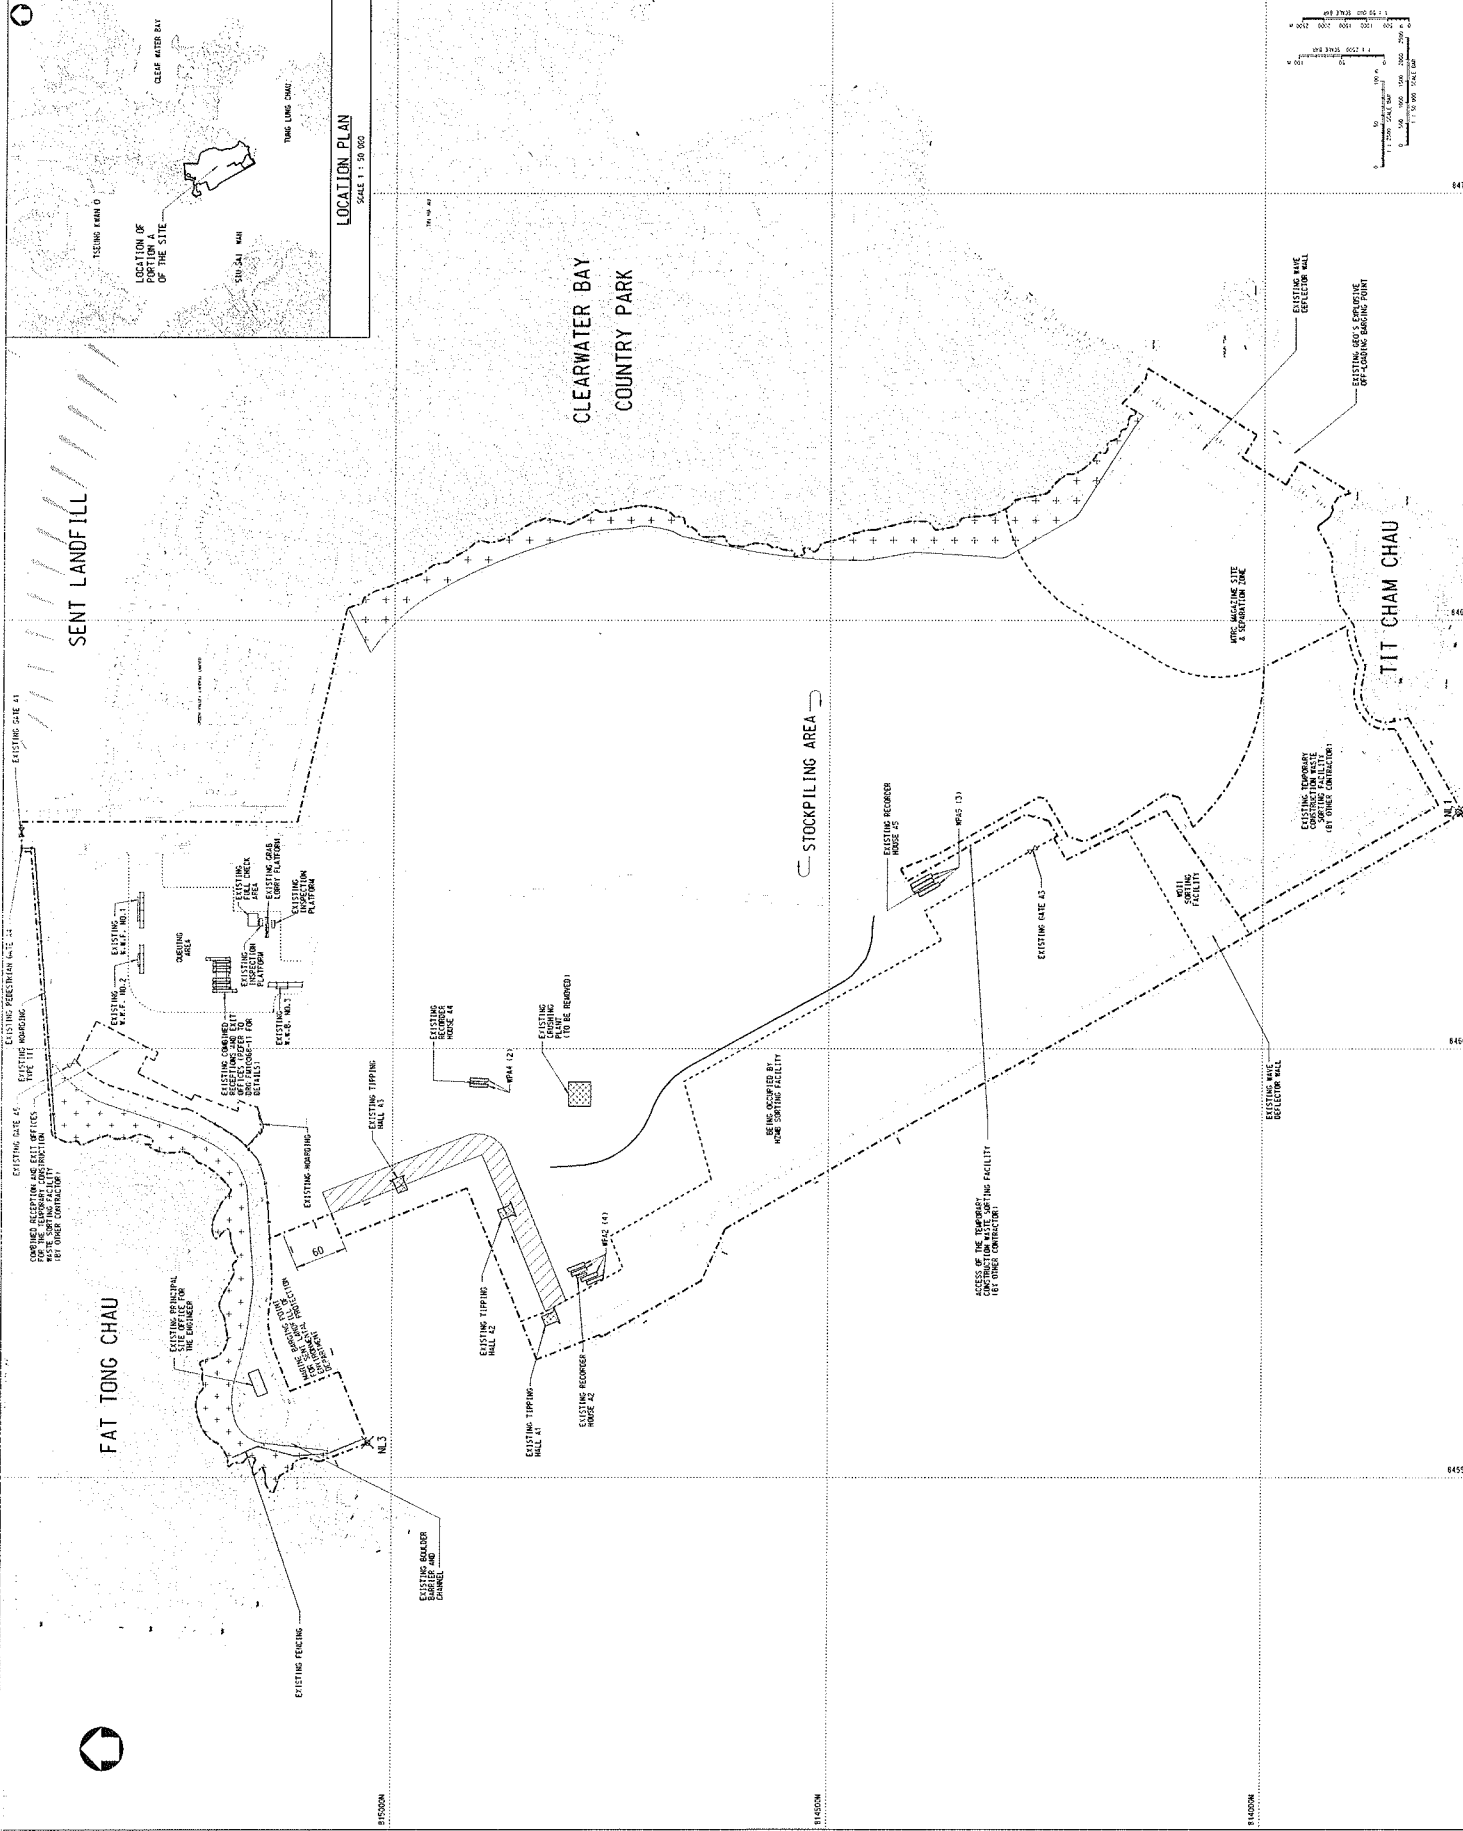

847000E  
845500E  
845000E  
844500E

COPYRIGHT RESERVED

B1 1000 X 1217





## Appendix I

### K

#### Monitoring Schedule for the Coming Month



## Contract No. CV/2013/06 Handling of Surplus Public Fill

### Tseung Kwan O Area137

Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hr TSP & 24-hr TSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitoring (NM)

**April 2014**

Sun	Mon	Tue	Wed	Thu	Fri	Sat
		1	2 <u>1-hr TSP</u> <u>Weekly SI</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (13:30-15:30)	3	4 <u>1-hr &amp; 24 hr TSP</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (14:30-16:30)	5
6	7 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (17:00-19:00)	8	9 <u>1-hr TSP</u> <u>Weekly SI</u> <u>NM</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (18:45-20:45)	10 <u>24 hr TSP</u>	11 <u>1-hr TSP x 2</u> <u>WQM</u> Mid-ebb (09:00 -11:00) Mid-flood (15:00 -17:00)	12
13	14 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (10:00 -12:00) Mid-flood (16:30 -18:30)	15	16 <u>1-hr TSP x 3</u> <u>24 hr TSP</u> <u>Weekly SI</u> <u>WQM</u> Mid-ebb (12:00 -14:00) Mid-flood (17:45 -19:45)	17	18	19
20	21	22 <u>24 hr TSP</u>	23 <u>1-hr TSP x 2</u> <u>Weekly SI</u> <u>WQM</u> Mid-flood (11:00-13:00) Mid-ebb (17:45-19:45)	24	25 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (08:30 -10:30) Mid-flood (14:00 -16:00)	26
27	28 <u>1-hr &amp; 24 hr TSP</u> <u>WQM</u> Mid-ebb (11:00 -13:00) Mid-flood (17:00 -19:00)	29	30 <u>1-hr TSP</u> <u>Weekly SI</u> <u>WQM</u> Mid-ebb (12:30 -14:30) Mid-flood (18:00 -20:00)			



## **Appendix I**

**L**

### **Complaint Log**




## Complaint Logs

Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
---	---	---	---	---	---



## Appendix I

### Figures

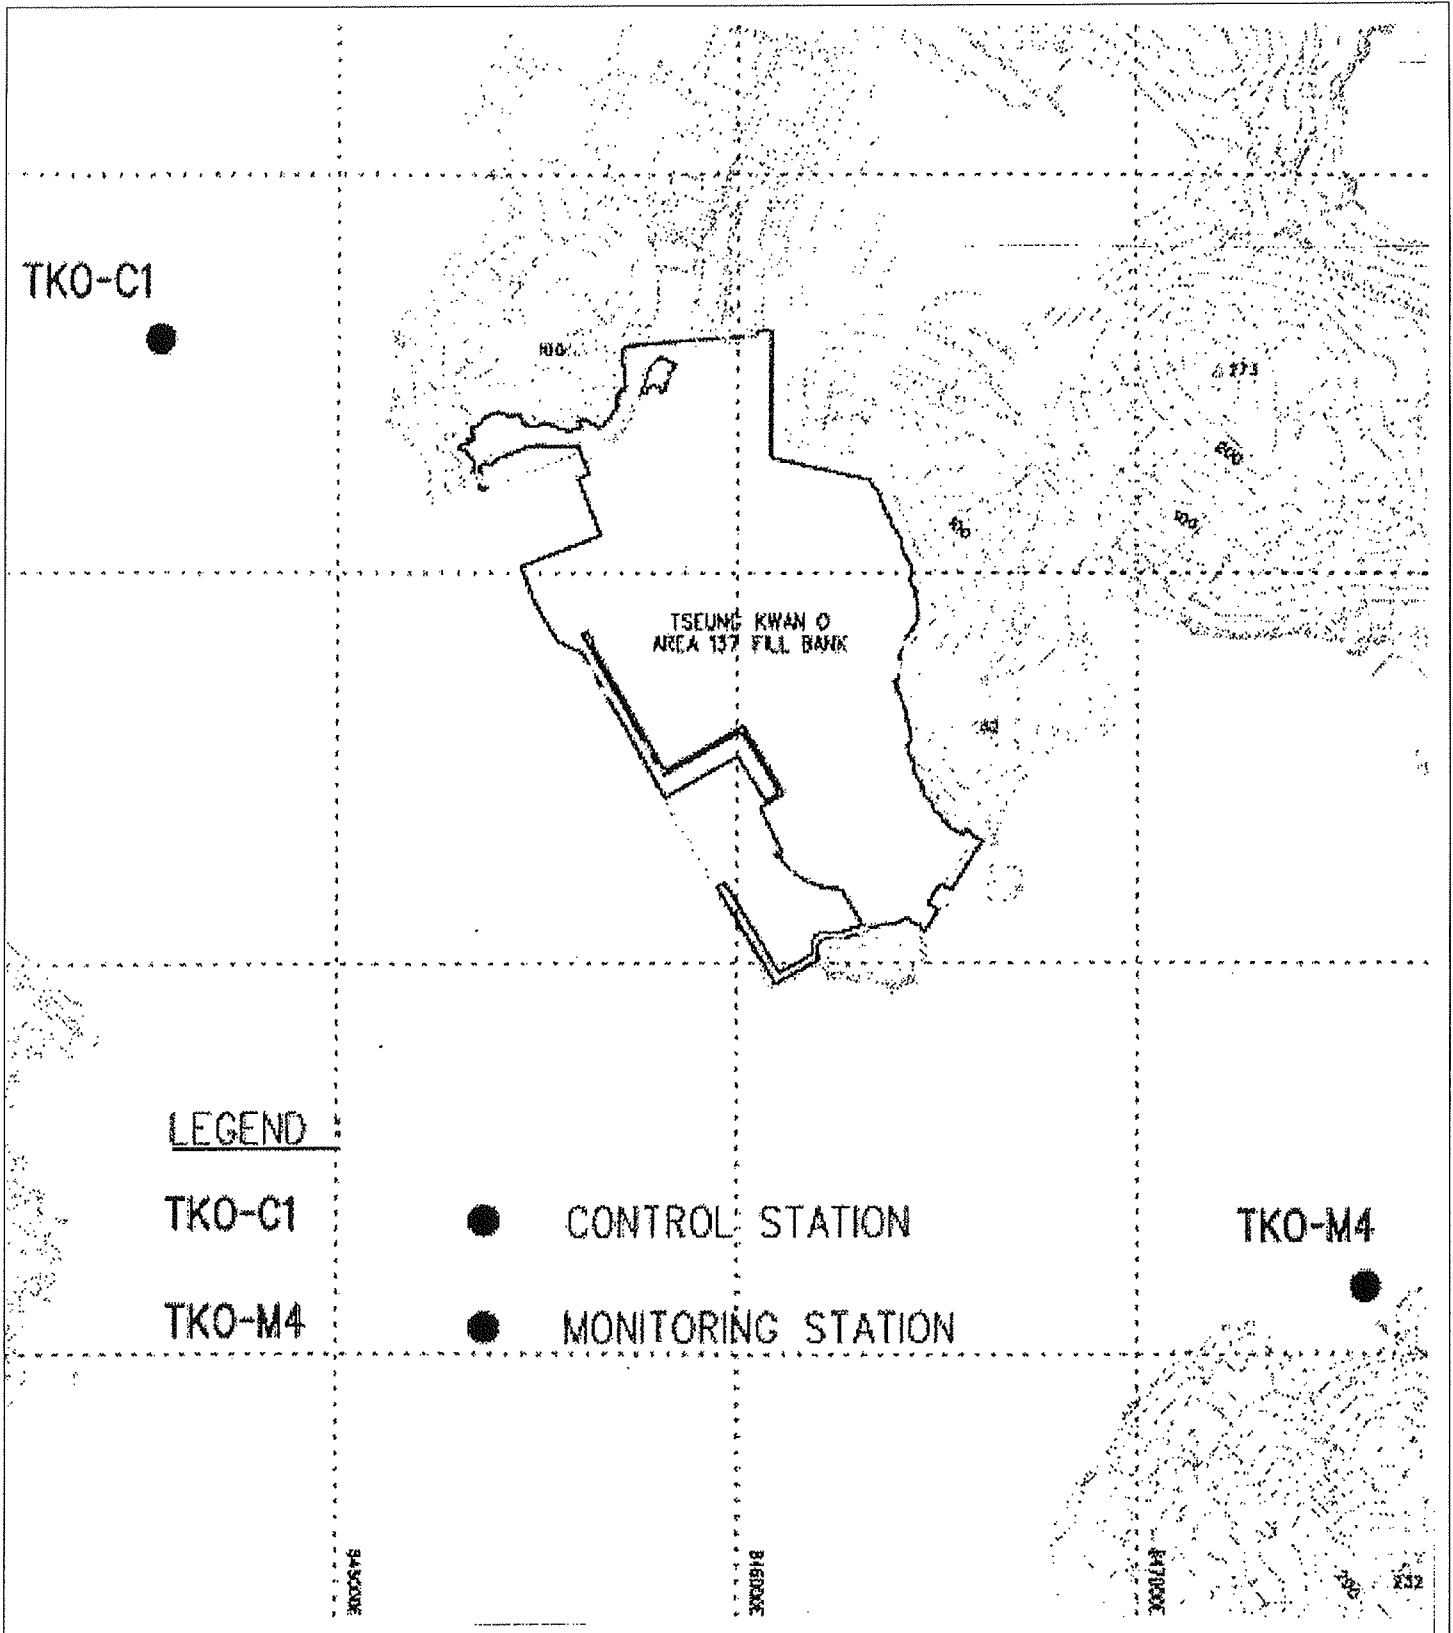


Contract No. CV/2013/06  
 Handling of Surplus Public Fill (2014-2016)

Figure 1  
 Locations of Water Quality Monitoring Stations –  
 Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司  
 ETS-TESTCONSULT LIMITED

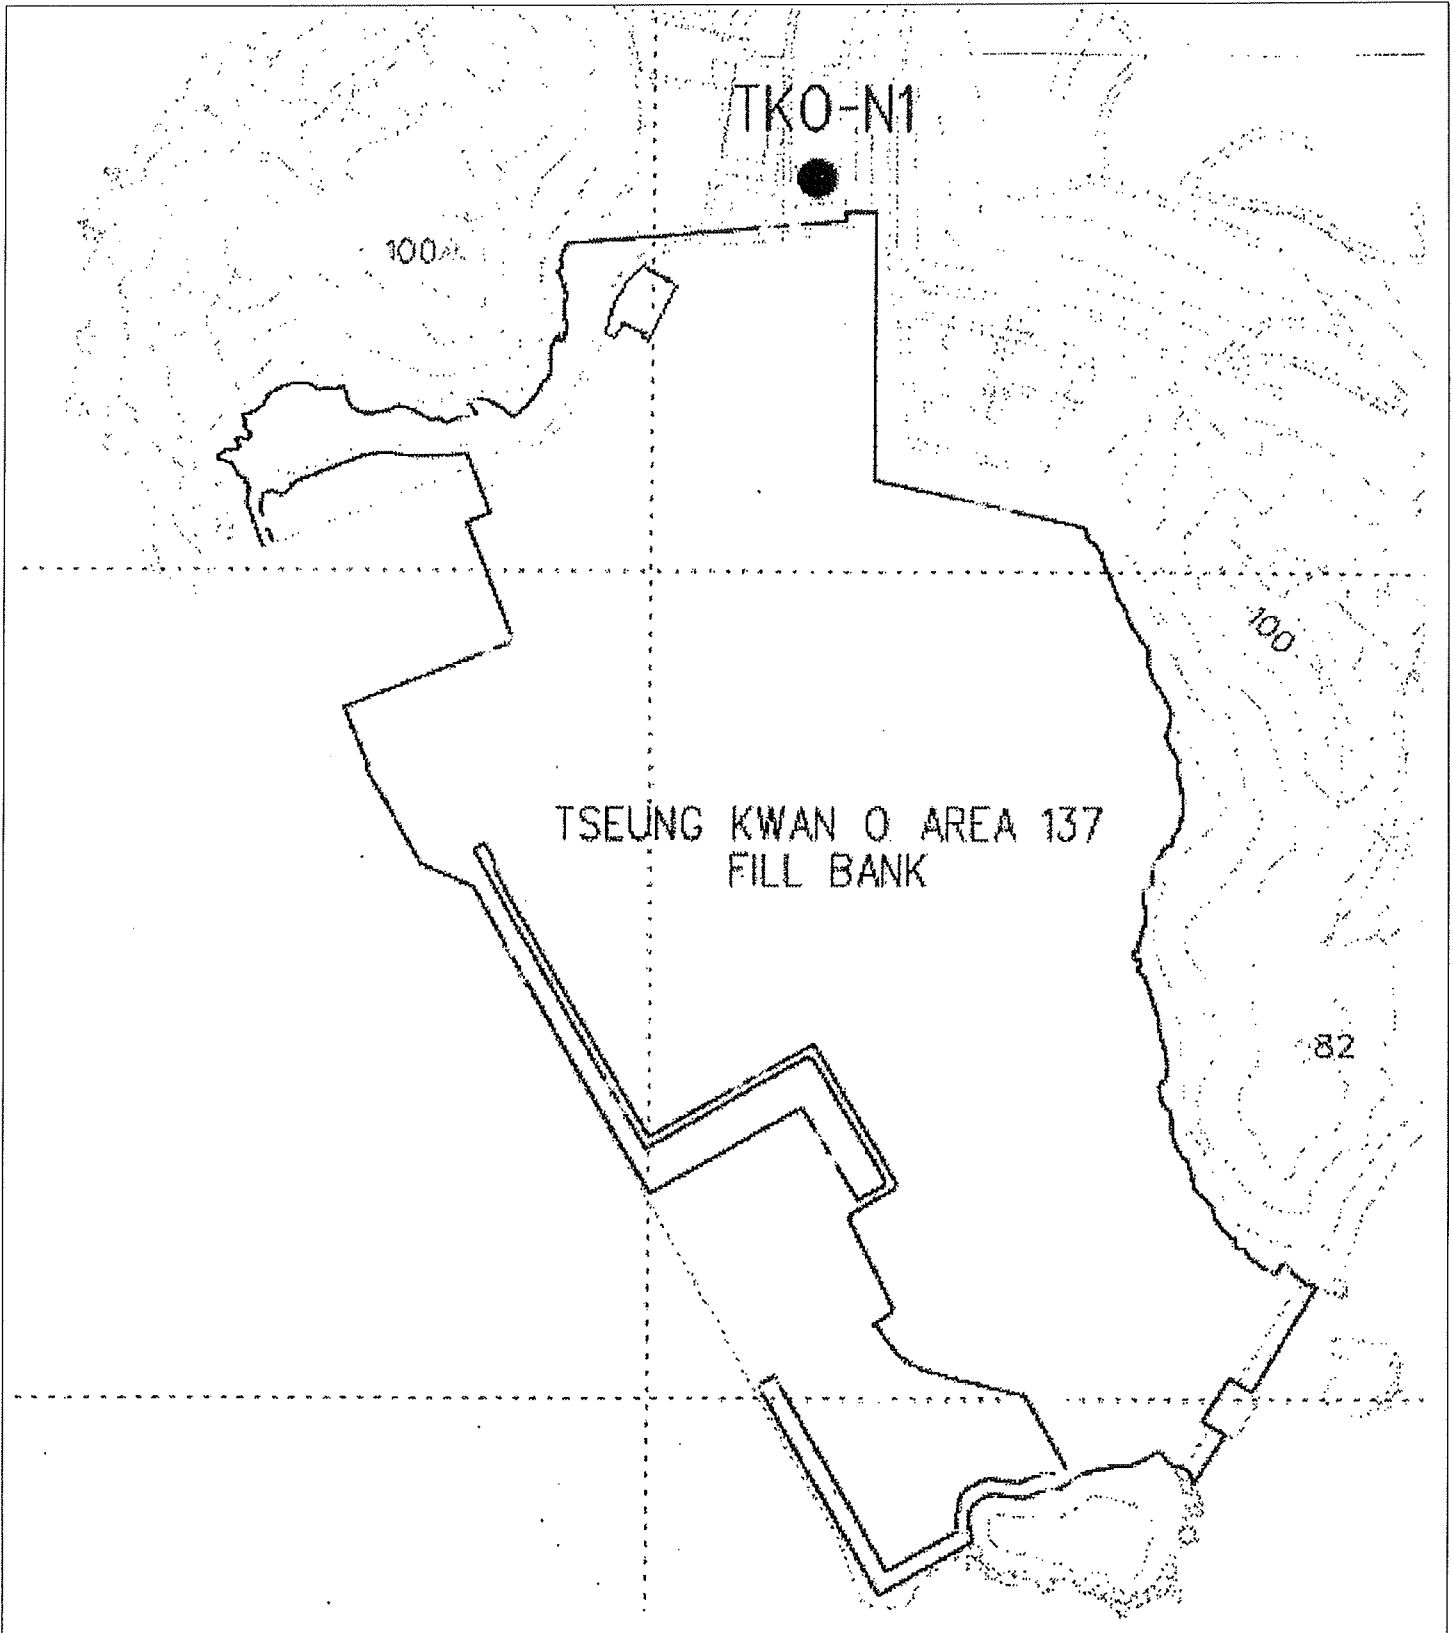


Contract No. CV/2013/06  
 Handling of Surplus Public Fill (2014-2016)

Figure 2  
 Location of Noise Monitoring Station –  
 Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司  
 ETS-TESTCONSULT LIMITED

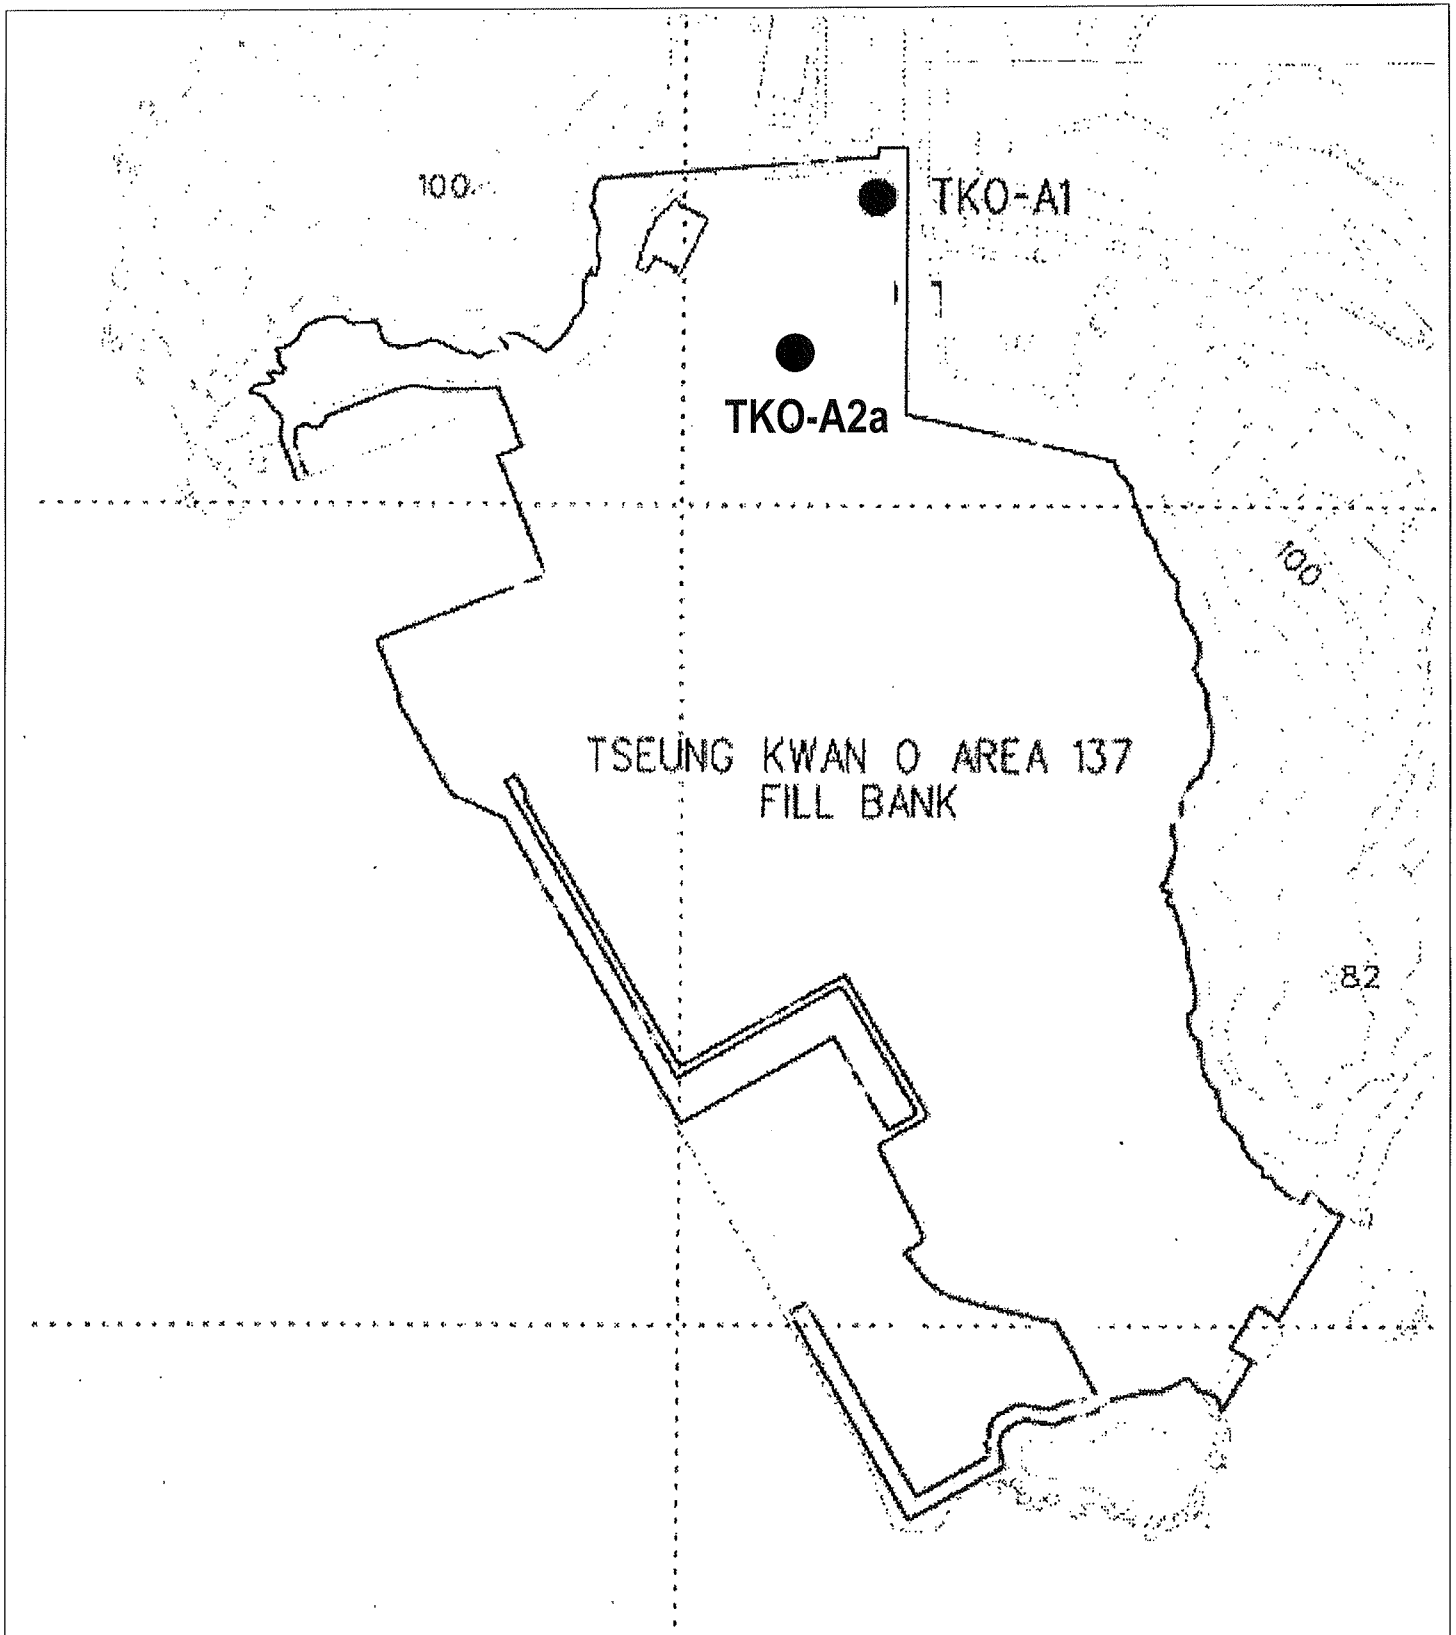

Contract No. CV/2013/06  
 Handling of Surplus Public Fill (2014-2016)

Figure 3  
 Locations of Air Quality Monitoring Stations –  
 Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司  
 ETS-TESTCONSULT LIMITED





## **Appendix II**

**Marine Water Quality Monitoring Report for Contract No. HY/2010/02  
Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing  
Facilities – Reclamation Works**



**China Harbour Engineering Company Limited**

Contract No. HY/2010/02

**Hong Kong – Zhuhai – Macao Bridge  
Hong Kong Boundary Crossing  
Facilities –  
Reclamation Works**

**Impact Water Quality Monitoring Report  
for TKO 137 Fill Bank  
March 2014**

[04/2014]

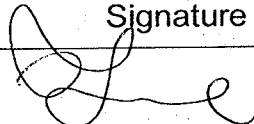	Name	Signature
Prepared & Checked:	Isabella Yeung	
Reviewed & Approved:	Y T Tang	

Version:	Rev. 0	Date: 14 April 2014
<p><b>Disclaimer</b></p> <p>This report is prepared for China Harbour Engineering Company Limited and is given for its sole benefit in relation to and pursuant to Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities-Reclamation Works and may not be disclosed to, quoted to or relied upon by any person other than China Harbour Engineering Company Limited without our prior written consent. No person (other than China Harbour Engineering Company Limited) into whose possession a copy of this report comes may rely on this report without our express written consent and China Harbour Engineering Company Limited may not rely on it for any purpose other than as described above.</p>		

AECOM Asia Co. Ltd.  
15/F, Grand Central Plaza, Tower 1, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong  
Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com

**TABLE OF CONTENTS**

	Page
EXECUTIVE SUMMARY .....	i
1 INTRODUCTION .....	1
1.1 Background .....	1
1.2 Purpose of the Report .....	1
1.3 Structure of the Report .....	1
2 WATER QUALITY .....	2
2.1 Monitoring Requirements .....	2
2.2 Monitoring Equipment .....	2
2.3 Monitoring Parameters, Frequency and Duration .....	2
2.4 Monitoring Locations .....	2
2.5 Monitoring Methodology .....	3
2.6 Action and Limit Levels .....	4
3 MONITORING RESULTS .....	5
4 CONCLUSIONS .....	7

**List of Tables**

Table 2.1	Water Quality Monitoring Equipment.....	2
Table 2.2	Water Quality Monitoring Parameters, Frequency and Duration .....	2
Table 2.3	Location of Water Quality Impact Stations .....	3
Table 2.4	Action and Limit Levels for Water Quality .....	4
Table 2.5	Summary of Marine Water Monitoring Results for Mid-ebb Tide .....	5
Table 2.6	Summary of Marine Water Monitoring Results for Mid-flood Tide .....	5
Table 2.7	Summary of Marine Water Monitoring Exceedance.....	6

**List of Figures**

Figure 1.1	Site Layout Plan for TKO 137 Fill Bank
Figure 2.1	Impact Water Quality Monitoring Stations at TKO 137 Fill Bank

**List of Appendices**

Appendix A	Calibration Records
Appendix B	Impact Monitoring Schedules
Appendix C	Impact Water Quality Monitoring Results and their Graphical Presentation
Appendix D	QA/QC Report

## EXECUTIVE SUMMARY

On-site sorting facilities for imported material (public fill) for reclamation works of the "Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as "the Project") were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below known as "the Works Area). Impact monitoring of water quality was conducted at the designated monitoring location. This report presents the impact monitoring results regarding water quality aspects performed in March 2014.

### *Water Quality*

Impact water quality monitoring was conducted at three monitoring stations, C1a, M4a & M5. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations. The impact monitoring was carried out three times per week (from 1 to 31 March 2014) during the operation of the mentioned facilities for both mid-ebb and mid-flood tides. Data of temperature, salinity, dissolved oxygen (DO), turbidity (Tby) and suspended solids (SS) were collected and analysed. Details of the monitoring methodology, locations and results are presented in this report.

### **Breaches of Action and Limit Levels for Water Quality**

No exceedance of Action and Limit Level of water quality monitoring results was recorded in the reporting month.

## 1 INTRODUCTION

### 1.1 Background

- 1.1.1 Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) mainly comprises reclamation at the northeast of the Hong Kong International Airport of an area of about 130-hectare for the construction of an artificial island for the development of the Hong Kong Boundary Crossing Facilities (HKBCF), and about 19-hectare for the southern landfall of the Tuen Mun - Chek Lap Kok Link (TMCLKL).
- 1.1.2 On-site sorting facilities for imported material (public fill) for reclamation works of the Project were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below, known as “the Works Area”). The proposed sorting facilities together with barging points, tipping halls and associated facilities will be installed at the Works Area.
- 1.1.3 The latest Environmental Permit (EP) for Fill Bank at TKO Area 137 was issued on 4 February 2013 (EP-134/2002/K) by the Environmental Protection Department (EPD) to Civil Engineering and Development Department (CEDD), the Permit Holder, regarding the Project. Condition 3.2 of the EP requires the water quality monitoring frequency and parameters at stations C1a, M4a and M5 shall be same as the requirements set out in the EM&A Manual for TKO 137 Fill Bank (here below, known as “EM&A Manual”) and the monitoring results shall be incorporated in the monthly EM&A reports.

### 1.2 Purpose of the Report

- 1.2.1 The purpose of this impact monitoring report is to assess environmental impact and compliance during transportation and operation of the mentioned facilities for the Project. This report presents the impact monitoring requirements, methodologies and results of water quality measurements in accordance with the EM&A Manual.
- 1.2.2 This impact report presents the monitoring works of water quality monitoring, at two monitoring stations (M4a and M5) and one control station (C1a), conducted in March 2014. A layout plan of the Works Area is provided in Figure 1.1.

### 1.3 Structure of the Report

- 1.3.1 The structure of the report is as follows:

Section 1: Introduction, background, purpose and the structure of the report.

Section 2: Water quality, which describes the impact water quality monitoring requirements, methodology and action/limit level.

Section 3: Impact water quality monitoring results.

Section 4: Conclusions.

## 2 WATER QUALITY

### 2.1 Monitoring Requirements

2.1.1 Impact marine water quality monitoring at 3 water quality monitoring stations should be established. In accordance with the EM&A Manual, impact water quality monitoring should be conducted 3 days per week during the operation of the facilities in the Works Area. Moreover, as stipulated in the latest EP, water quality monitoring should be conducted since 2 weeks before commencement of operation of the additional barging points. Measurements shall be taken at the 3 designated stations, 2 impact and 1 control stations at mid-flood and mid-ebb tides at three water depths, i.e., 1 m below surface, mid-depth and 1 m from seabed.

### 2.2 Monitoring Equipment

2.2.1 Equipment used in the impact water quality monitoring programme is summarized in Table 2.1. A copy of the calibration certificates for the water quality monitoring equipment are attached in Appendix A.

**Table 2.1 Water Quality Monitoring Equipment**

Parameter	Model and Make
Coordinate of Monitoring stations	Garmin etrex 10
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI Pro2030
Turbidity	HACH Model 2100Q Turbid Meter
Water Depth	Speedtech Instrument SM-5A

### 2.3 Monitoring Parameters, Frequency and Duration

2.3.1 Table 2.2 summarises the monitoring parameters, frequency and duration of impact water quality monitoring. Impact water quality monitoring was carried out at three stations in March 2014. Detailed impact water quality monitoring schedule was provided in Appendix B.

**Table 2.2 Water Quality Monitoring Parameters, Frequency and Duration**

Monitoring Stations	Parameter, unit	Frequency	No. of Depths
<p><i>Control Stations:</i> C1a</p> <p><i>Impact Stations:</i> M4a – M5</p>	<ul style="list-style-type: none"> <li>• Depth, m</li> <li>• Temperature, °C</li> <li>• Salinity, ppt</li> <li>• DO, mg/L</li> <li>• DO Saturation, %</li> <li>• Turbidity, NTU</li> <li>• Suspended Solids (SS), mg/L</li> </ul>	<p>Three times per week during mid-ebb and mid-flood tides (within ± 1.75 hour of the predicted time)</p>	<p>3 (1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth is less than 6 m, in which case the mid-depth station may be omitted. Should the water depth be less than 3 m, only the mid-depth station will be monitored).</p>

### 2.4 Monitoring Locations

2.4.1 The measurements were taken at all designated impact and control stations summarized in Table 2.3. The two impact stations were chosen on the basis of their proximity to the Works Area, which would be under the greatest potential for water quality impacts. In addition, a control station was also set up for ebb-tide references respectively of the surrounding ambient.

**Table 2.3 Location of Water Quality Impact Stations**

Station I.D.	HK 1980 Grid		Status
	Easting	Northing	
C1a	845647	814146	Control Station (Ebb-tide)
M4a	845922	813973	Impact Station (Close to Additional Barging Point, Tipping Halls and Associated Facilities at TKO 137 Fill Bank)
M5	847005	813678	Impact Station (Close to Tai Miu Wan)

## 2.5 Monitoring Methodology

### 2.5.1 Instrumentation

- (a) The in-situ water quality parameters, viz. dissolved oxygen, temperature, salinity and turbidity were measured by multi-parameter meters and turbidity was measured by Turbid Meter.

### 2.5.2 Operating/Analytical Procedures

- (a) A hand-held digital Global Positioning Systems (GPS) were used to ensure that the correct location was selected prior to sample collection.
- (b) Portable, battery-operated echo sounders were used for the determination of water depth at each designated monitoring station.
- (c) All in-situ measurements were taken at 3 water depths, 1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth was less than 6 m, in which case the mid-depth station was omitted. Should the water depth be less than 3 m, only the mid-depth station was monitored.
- (d) At each measurement/sampling depth, two consecutive in-situ monitoring (DO concentration and saturation, temperature, turbidity, salinity) and water sample for SS were collected. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO concentration and saturation, temperature and salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. Where the difference in the value between the first and second readings of DO or turbidity parameters was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- (e) Duplicate samples from each independent sampling event were collected for SS measurement. Water samples were collected using the water samplers and the samples were stored in high-density polythene bottles. Water samples collected were well-mixed in the water sampler prior to pre-rinsing and transferring to sample bottles. Sample bottles were pre-rinsed with the same water samples. The sample bottles were then be packed in cool-boxes (cooled at 4°C without being frozen), and delivered to Environmental Laboratory, ETS-Testconsult Ltd. (HOKLAS Registration No. 022) for the analysis of suspended solids concentrations. The laboratory determination work would be started within 24 hours after collection of the water samples. Environmental Laboratory, ETS-Testconsult Ltd., is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes. For QA/QC procedures, one duplicate samples of every batch of 20 samples was analyzed and attached in Appendix D.

### 2.5.3 Maintenance and Calibration

- (a) Before each round of monitoring, the dissolved oxygen probe of YSI Pro2030 was calibrated by the wet bulb method.
- (b) The monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS before use and subsequently re-calibrated at 3-monthly intervals throughout all stages of the water quality monitoring.



**2.6 Action and Limit Levels**

2.6.1 The Action and Limit Levels (AL levels) have been set in accordance with the derivation criteria specified in the EM&A Manual. This is shown in Table 2.4.

**Table 2.4 Action and Limit Levels for Water Quality**

Parameters	Action	Limit
DO in mg/L (Surface & Middle, Bottom)	Surface & Middle 5.5 mg/L  Bottom 5.2 mg/L	Surface & Middle 4.0 mg/L  Bottom 2.0 mg/L
SS in mg/L (depth-averaged)	4.9 mg/L or 120% of upstream control station's SS at the same tide of the same day	5.2 mg/L or 130% of upstream control station's SS at the same tide of the same day and specific sensitive receiver water quality requirements (e.g. required suspended solids level at FCZ)
Turbidity in NTU (depth-averaged)	3.9 NTU or 120% of upstream control station's turbidity at the same tide of the same day	4.2 NTU or 130% of upstream control station's turbidity at the same tide of the same day

- Notes:
1. "depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
  2. For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
  3. For turbidity, SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.
  4. All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.

### 3 MONITORING RESULTS

3.1.1 The impact water quality monitoring results for C1a, M4a and M5 are summarized in Tables 2.5 and 2.6. Detail water quality monitoring results are presented in Appendix C.

**Table 2.5 Summary of Marine Water Monitoring Results for Mid-ebb Tide**

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	16.6 (15.8 - 17.4)	28.7 (27.1 - 30.7)	6.7 (6 - 7.4)	6.7 (6 - 7.2)	82.9 (72.1 - 92.9)	3.0 (1.4 - 4.3)	4.1 (2.4 - 5.4)
M4a	17.3 (16.7 - 17.7)	28.6 (26.1 - 29.8)	6.7 (6.1 - 7.6)	6.7 (6.1 - 7.4)	88.6 (83.8 - 95.9)	2.6 (2 - 3.6)	3.6 (3 - 4.8)
M5	17.3 (16.8 - 17.7)	28.5 (26 - 29.8)	6.8 (6.1 - 7.6)	6.7 (6 - 7.4)	90.5 (82.2 - 95.6)	2.4 (1.9 - 3.7)	3.5 (2.8 - 4.8)

**Table 2.6 Summary of Marine Water Monitoring Results for Mid-flood Tide**

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	16.6 (15.9 - 17.5)	28.7 (27.2 - 30.7)	6.8 (6.1 - 7.5)	6.8 (6.1 - 7.3)	83.9 (73.2 - 93.8)	2.9 (1.4 - 4)	4.0 (2.4 - 5)
M4a	16.6 (15.9 - 17.4)	28.7 (27.2 - 30.7)	6.8 (6.2 - 7.6)	6.7 (6 - 7.4)	83.9 (72.2 - 93.5)	2.8 (1.7 - 3.7)	3.8 (2.6 - 4.8)
M5	16.7 (15.8 - 17.4)	28.7 (27.2 - 30.7)	6.9 (6.2 - 7.7)	6.8 (6 - 7.5)	84.5 (73.6 - 93.9)	2.7 (1.4 - 3.8)	3.8 (2.4 - 4.8)

3.1.2 The weather conditions during the monitoring period were generally cloudy with a few drizzle days. Sea conditions for the majority of monitoring days were generally small wave however with a few great wave day. No major water pollution source, which might affect the result observed during the impact monitoring period.

3.1.3 Since the water depths at all the monitoring stations were generally higher than 6m, sampling was conducted at three water depths at each station.

3.1.4 The summary of impact water quality exceedance is shown in Table 2.7.

**Table 2.7 Summary of Marine Water Monitoring Exceedance**

Monitoring Station	Exceedance Level	DO (SM)		DO(Bottom)		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
M4a	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0
M5	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0


Note: S: Surface; and  
 M: Mid-depth.

3.1.5 No exceedance of Action and Limit Level of water quality monitoring results was recorded in the reporting month.


## 4 CONCLUSIONS

- 4.1.1 This impact monitoring report presents impact monitoring results for water quality at designated locations C1a, M4a and M5 in accordance with the EM&A Manual. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations.
- 4.1.2 All laboratory results satisfied the QA/QC requirements and all monitoring equipment is properly calibrated and with valid calibration certificates.
- 4.1.3 No exceedance of Action and Limit Level of water quality monitoring results was recorded in the reporting month.

**FIGURES**

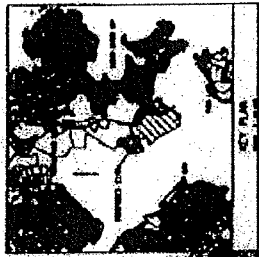

SENT LANDFILL



Barging Points at TKO Basin  
(condition 2.8A refers)

Construction and Demolition  
Material Crushing Facility  
(condition 2.8A refers)

North Portion of Stockpiling  
Area (condition 2.8A refers)

Area of Proposed Construction and  
Demolition Sorting Facilities  
(condition 2.8B refers)

Southern Portion of Construction  
and Demolition Material Sorting  
Facility (condition 2.8A refers)

Proposed additional  
Barging Points and  
Tipping Halls by HKBCF  
(condition 2.8B refers)

Temporary Barging Point  
at GEO's Explosives  
Off-Loading Barging  
Point (condition 2.9  
refers)



(Plan Originated from Figure 2 of Environmental Permit No.: EP-134/2002/K)


This Drawing has been prepared for the use of AECOM's clients. AECOM shall not be held responsible for any errors or omissions in this drawing. AECOM shall not be held responsible for any errors or omissions in this drawing. AECOM shall not be held responsible for any errors or omissions in this drawing.

**HONG KONG - ZHUHAI - MACAO BRIDGE  
HONG KONG BOUNDARY CROSSING FACILITIES  
RECLAMATION WORKS**

Site Layout Plan for TKO 137 Fill Bank

Project No.: 60249820 Date: MAY 2012



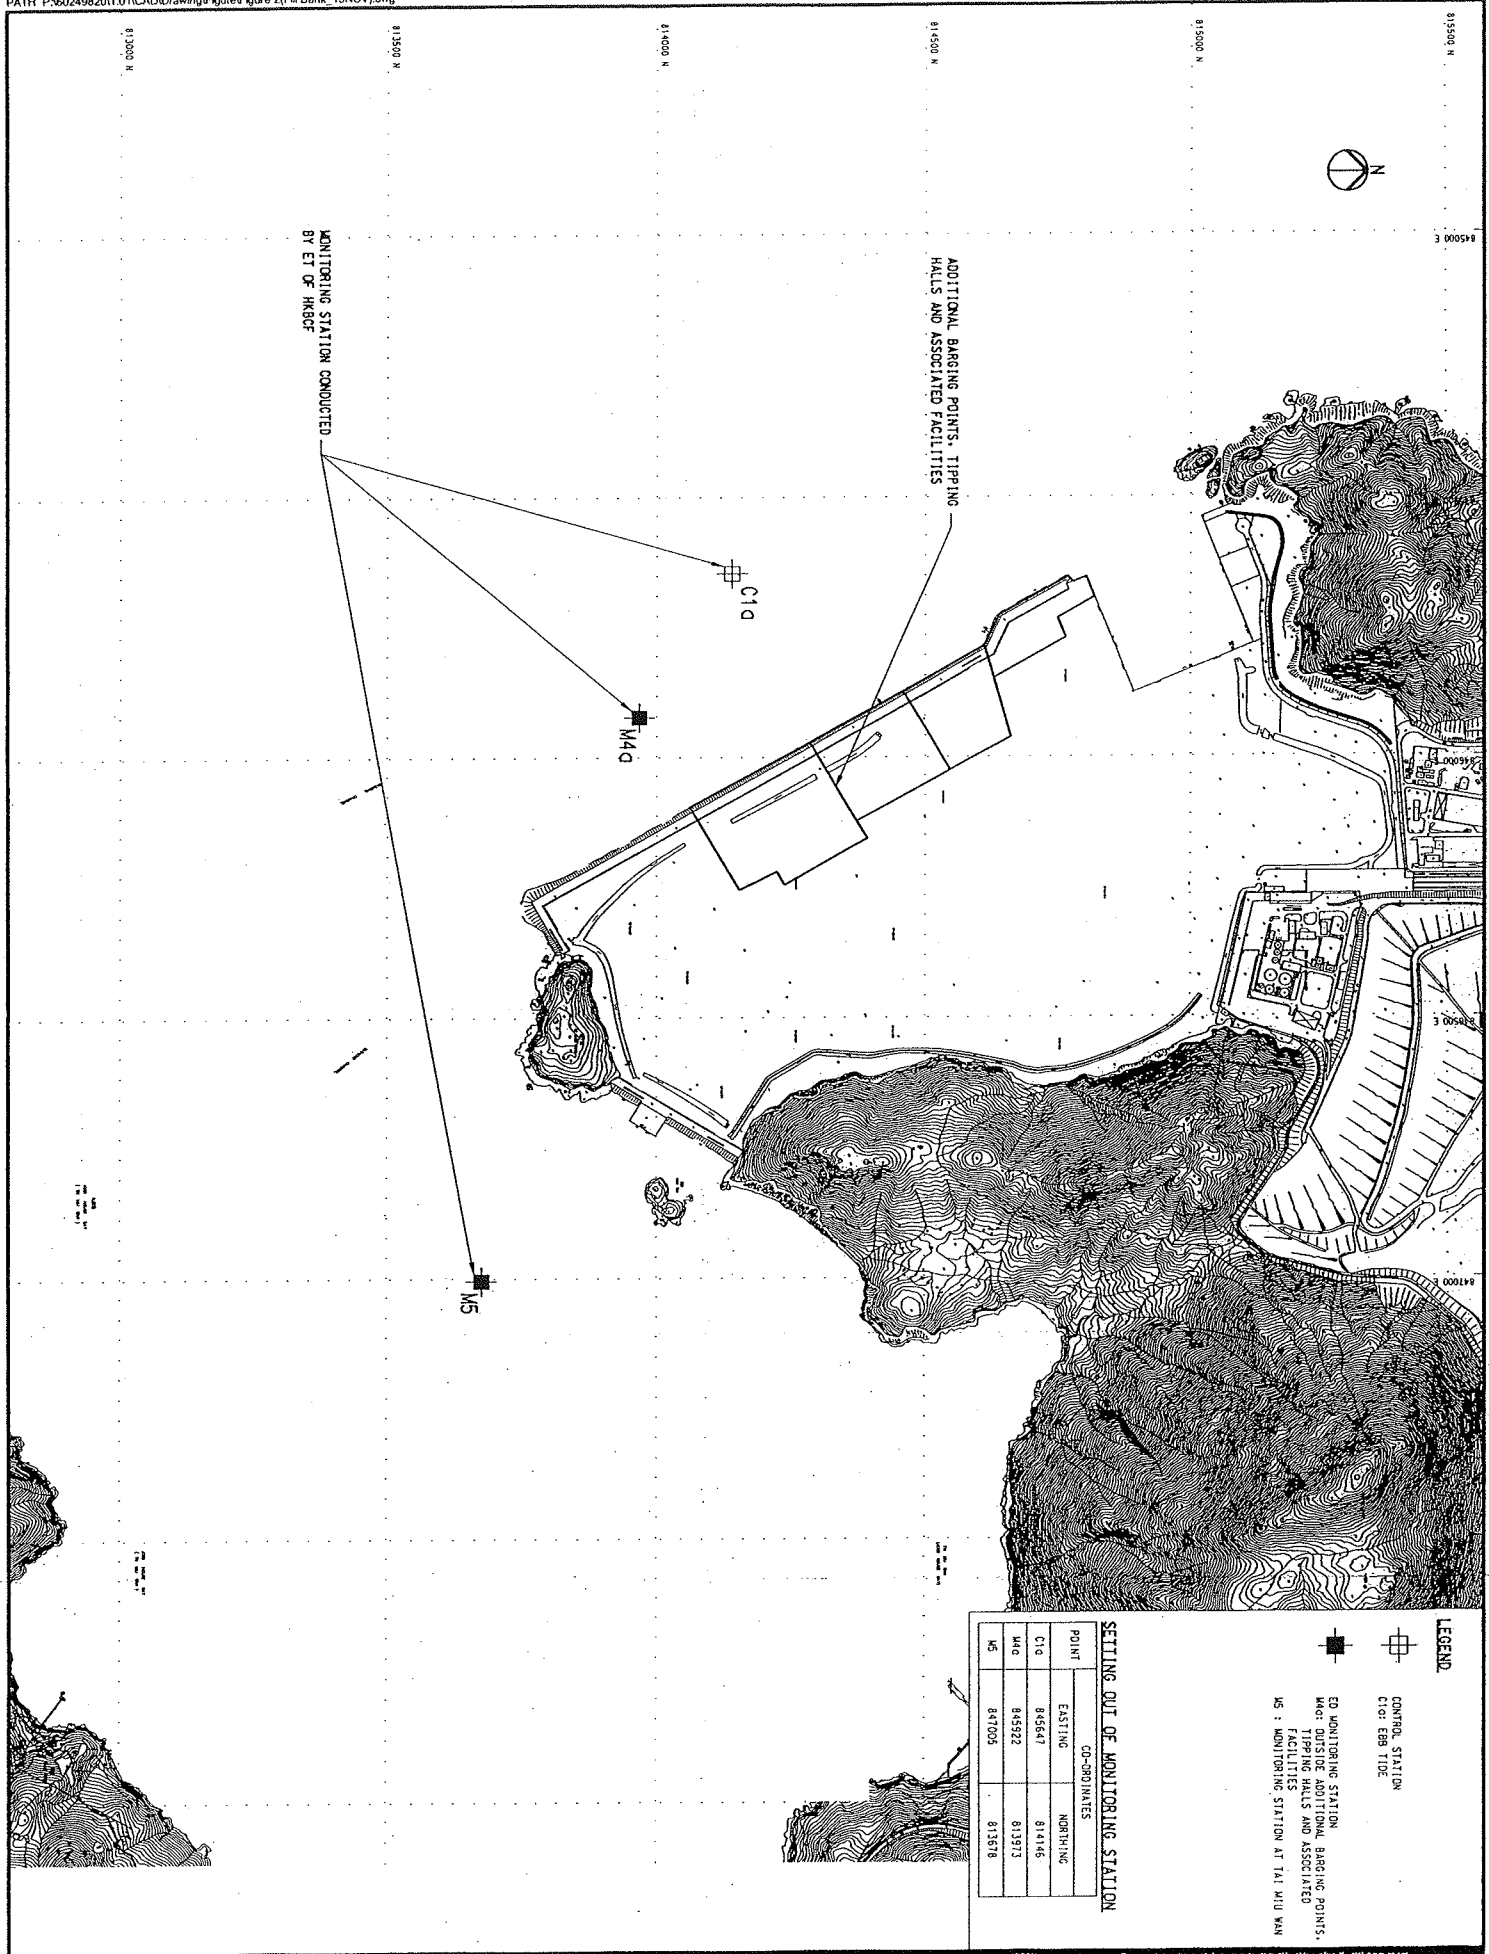

**APPENDIX A  
CALIBRATION RECORDS**





### Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/005</u>	Manufacturer : <u>YSI</u>
Model No. : <u>Pro 2030</u>	Serial No. : <u>12A 100353</u>
Date of Calibration : <u>29/01/2014</u>	Calibration Due Date : <u>28/04/2014</u>

#### Temperature Verification

Ref. No. of Reference Thermometer : ET/0521/008

Ref. No. of Water Bath : ---

	Temperature (°C)			
	Measured	20.2	Corrected	19.8
Reference Thermometer reading	Measured	20.2	Corrected	19.8
DO Meter reading	Measured	19.7	Difference	0.1

#### Standardization of sodium thiosulphate (Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>) solution

Reagent No. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> titrant	CPE/012/4.5/001/8	Reagent No. of 0.025N K <sub>2</sub> Cr <sub>2</sub> O <sub>7</sub>	CPE/012/4.4/001/24
		Trial 1	Trial 2
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		0.00	10.50
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)		10.50	20.95
Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)		10.50	10.45
Normality of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02381	0.02392
Average Normality (N) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> solution (N)		0.02387	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub>, N = 0.25 / ml Na<sub>2</sub>S<sub>2</sub>O<sub>3</sub> used

#### Linearity Checking

##### Determination of dissolved oxygen content by Winkler Titration \*

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	11.90	23.50	0.00	8.20	13.20
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	11.90	23.50	31.90	8.20	13.20	17.90
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	11.90	11.60	8.40	8.20	5.00	4.70
Dissolved Oxygen (DO), mg/L	7.63	7.43	5.38	5.25	3.20	3.01
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V × N × 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.65	7.41	7.53	7.63	7.43	7.53	0.00
5	5.38	5.21	5.30	5.38	5.25	5.32	0.38
10	3.22	3.09	3.16	3.20	3.01	3.11	1.59
Linear regression coefficient				0.9998			



### Internal Calibration Report of Dissolved Oxygen Meter

**Zero Point Checking**

DO meter reading, mg/L	0.00
------------------------	------

**Salinity Checking**

Reagent No. of NaCl (10ppt)	CPE/012/4.7/002/15	Reagent No. of NaCl (30ppt)	CPE/012/4.8/002/15
-----------------------------	--------------------	-----------------------------	--------------------

**Determination of dissolved oxygen content by Winkler Titration \*\***

Salinity (ppt)	10		30	
	1	2	1	2
Initial Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	0.00	12.30	24.40	35.80
Final Vol. of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> (ml)	12.30	24.40	35.80	47.00
Vol. (V) of Na <sub>2</sub> S <sub>2</sub> O <sub>3</sub> used (ml)	12.30	12.10	11.40	11.20
Dissolved Oxygen (DO), mg/L	7.88	7.75	7.31	7.18
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation:  $DO (mg/L) = V \times N \times 8000/298$

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.88	7.65	7.77	7.88	7.75	7.82	0.64
30	7.23	7.14	7.19	7.31	7.18	7.25	0.83

**Acceptance Criteria**

- (1) Differenc between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / does-not-comply # with the specified requirements and is deemed acceptable # / unacceptable # for use.

# Delete as appropriate

Calibrated by :

Approved by :



## Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/005      Manufacturer : YSI  
Model No. : Pro 2030      Serial No. : 12A 100353  
Date of Calibration : 29/01/2014      Due Date : 28/04/2014

Ref. No. of Salinity Standard used (30ppt)


S/001/5


Salinity Standard (ppt)	Measured Salinity (ppt)	Difference %
30.0	30.9	3.00

Acceptance Criteria

Difference : <10 %

The salinity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 



## Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/010                      Manufacturer : HACH  
Model No. : 2100Q                                      Serial No. : 11110 C 014260  
Date of Calibration : 07/01/2014                      Due Date : 06/04/2014

Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	19.2	-4.08
100	104	3.92
800	793	-0.88


(\* ) Difference = (Measured Value – Theoretical Value) / Theoretical Value

Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies \* / ~~does not comply~~ \* with the specified requirements and is deemed acceptable \* / ~~unacceptable~~ \* for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 

**APPENDIX B  
IMPACT MONITORING SCHEDULES**

**Contract No. HY/2010/02 - Hong Kong-Zhuhai-Macao Bridge  
Hong Kong Boundary Crossing Facilities – Reclamation Works  
Impact Water Quality Monitoring Schedule for March 2014 (TKO 137 Fill Bank)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
						01-Mar
02-Mar	03-Mar	04-Mar	05-Mar	06-Mar	07-Mar	08-Mar
	Impact Water Quality Monitoring Mid-ebb: 13:49 Mid-flood: 19:48		Impact Water Quality Monitoring Mid-flood: 08:55 Mid-ebb: 15:13		Impact Water Quality Monitoring Mid-flood: 10:02 Mid-ebb: 16:55	
09-Mar	10-Mar	11-Mar	12-Mar	13-Mar	14-Mar	15-Mar
	Impact Water Quality Monitoring Mid-flood: 08:19 Mid-ebb: 20:50		Impact Water Quality Monitoring Mid-ebb: 10:09 Mid-flood: 15:14		Impact Water Quality Monitoring Mid-ebb: 11:16 Mid-flood: 16:56	
16-Mar	17-Mar	18-Mar	19-Mar	20-Mar	21-Mar	22-Mar
	Impact Water Quality Monitoring Mid-ebb: 12:43 Mid-flood: 18:55		Impact Water Quality Monitoring Mid-flood: 07:43* Mid-ebb: 13:53		Impact Water Quality Monitoring Mid-flood: 08:47 Mid-ebb: 15:15	
23-Mar	24-Mar	25-Mar	26-Mar	27-Mar	28-Mar	29-Mar
	Impact Water Quality Monitoring Mid-flood: 11:03 Mid-ebb: 18:34		Impact Water Quality Monitoring Mid-ebb: 08:46 Mid-flood: 13:56		Impact Water Quality Monitoring Mid-flood: 10:40 Mid-ebb: 16:17	
30-Mar	31-Mar					
	Impact Water Quality Monitoring Mid-ebb: 12:45 Mid-flood: 18:55					

(\*) Proposed WQM on 19 March 2014 (Flood tide) will be carried out between 0800 to 1000 due to the construction works start from 0800. The proposed WQM period was within the flood tide (0431 to 1055 on 19 March 2014).

**APPENDIX C  
IMPACT WATER QUALITY MONITORING  
RESULTS AND THEIR GRAPHICAL  
PRESENTATION**

**Mid-Ebb Tide**

**Monitoring Station : C1a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
03/03/14	1324-1344	18/Cloudy	Great Wave	19.2	Surface	17.2	29.2	7.3	7.3	94.8	2.3	2.3	3.6	3.6	3.6	3.6	
					Middle	17.1	29.1	7.3	7.3	95.2	2.3	2.3	3.6				
					Bottom	17.3	29.2	7.2	7.2	93.9	2.6	2.6	4.0				
05/03/14	1454-1514	17/Cloudy	Small Wave	19.0	Surface	17.4	29.3	7.1	7.1	93.4	2.8	2.8	4.0	4.0	4.0	4.0	
					Middle	17.3	29.2	7.2	7.2	93.7	2.6	2.6	3.6				
					Bottom	17.4	29.3	7.1	7.1	93.1	2.7	2.7	4.0				
07/03/14	1601-1621	17/Cloudy	Small Wave	19.2	Surface	17.4	29.0	7.0	7.0	92.0	3.5	3.5	4.6	4.6	4.6	4.6	
					Middle	17.3	29.1	7.3	7.3	95.3	3.3	3.3	4.4				
					Bottom	17.4	29.0	7.0	7.0	91.7	3.6	3.6	4.8				
10/03/14	1936-1951	17/Cloudy	Small Wave	19.5	Surface	17.3	29.3	7.1	7.1	93.2	2.3	2.3	3.2	3.2	3.2	3.2	
					Middle	17.1	29.3	7.2	7.2	93.8	2.2	2.2	3.6				
					Bottom	17.3	29.4	7.1	7.1	93.4	2.6	2.6	3.6				
12/03/14	0930-0948	18/Cloudy	Small Wave	19.2	Surface	17.3	29.5	7.1	7.1	92.9	2.7	2.7	3.8	3.8	3.8	3.8	
					Middle	17.5	29.6	7.0	7.0	85.7	2.8	2.8	3.8				
					Bottom	17.4	29.6	7.0	7.0	93.0	2.7	2.7	3.6				
14/03/14	1024-1042	18/Cloudy	Small Wave	18.8	Surface	17.4	29.4	7.2	7.2	84.9	2.9	2.9	4.0	4.0	4.0	4.0	
					Middle	17.5	29.3	7.2	7.2	93.6	2.3	2.3	3.4				
					Bottom	17.5	29.5	7.0	7.0	93.7	2.3	2.3	3.6				
17/03/14	1254-1314	19/Cloudy	Small Wave	19.2	Surface	17.3	29.3	7.5	7.5	92.3	2.3	2.3	3.2	3.2	3.2	3.2	
					Middle	17.2	29.4	7.5	7.5	92.8	2.3	2.3	3.6				
					Bottom	17.3	29.4	7.3	7.3	90.8	2.4	2.4	3.6				
19/03/14	1354-1414	24/Cloudy	Small Wave	19.8	Surface	17.4	29.3	7.2	7.2	90.6	2.4	2.4	3.4	3.4	3.4	3.4	
					Middle	17.4	29.4	7.2	7.2	89.5	2.5	2.5	3.8				
					Bottom	17.4	29.6	6.9	6.9	89.7	2.5	2.5	3.8				
19/03/14	1354-1414	24/Cloudy	Small Wave	19.8	Surface	17.3	29.4	7.0	7.0	86.9	3.4	3.4	4.4	4.4	4.4	4.4	
					Middle	17.3	29.4	7.0	7.0	87.1	3.3	3.3	4.4				
					Bottom	17.4	29.5	7.1	7.1	88.3	3.6	3.6	4.8				
19/03/14	1354-1414	24/Cloudy	Small Wave	19.8	Surface	17.4	29.5	7.2	7.2	88.2	3.5	3.5	4.8	4.8	4.8	4.8	
					Middle	17.5	29.6	6.8	6.8	84.7	3.4	3.4	4.4				
					Bottom	17.4	29.6	6.9	6.9	85.0	3.5	3.5	4.6				
19/03/14	1354-1414	24/Cloudy	Small Wave	19.8	Surface	16.9	26.0	7.2	7.2	86.2	2.5	2.5	3.6	3.6	3.6	3.6	
					Middle	16.9	26.0	7.2	7.2	86.6	2.5	2.5	3.6				
					Bottom	16.6	26.1	7.3	7.3	87.5	2.7	2.7	4.0				
19/03/14	1354-1414	24/Cloudy	Small Wave	19.8	Surface	16.7	26.1	7.3	7.3	87.9	2.8	2.8	4.0	4.0	4.0	4.0	
					Middle	16.6	26.1	7.3	7.3	87.1	2.4	2.4	3.6				
					Bottom	16.6	26.1	7.2	7.2	86.9	2.5	2.5	3.4				



**Mid-Ebb Tide**

**Monitoring Station : C1a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Middle		Bottom	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
21/03/14	1454-1512	21/Cloudy	Small Wave	20.2	Surface	1.0	16.9	26.1	26.2	7.2	7.2	86.7	2.4	3.6	2.5	3.6		
							16.8	26.2	7.2	87.2	2.5	3.6						
							16.9	26.3	7.3	88.1	2.7	4.0						
					Middle	10.1	16.9	26.2	7.3	88.3	2.7	3.6						
							16.9	26.3	7.3	87.6	2.4	3.6						
							16.8	26.4	7.3	88.2	2.4	3.4						
24/03/14	1750-1810	22/Cloudy	Small Wave	19.2	Surface	1.0	17.4	26.1	26.1	7.2	7.1	87.7	2.6	3.6	2.8	4.0		
							17.3	26.1	7.1	87.0	2.7	4.0						
							17.2	26.2	7.0	85.8	2.7	4.0						
					Middle	9.6	17.3	26.2	7.0	85.5	2.8	4.0						
							17.1	26.4	7.1	85.9	2.9	3.8						
							17.1	26.4	7.1	86.4	2.9	3.8						
26/03/14	0838-0854	21/Fine	Small Wave	19.4	Surface	1.0	17.6	29.6	29.6	7.3	7.3	90.2	2.2	3.4	2.3	3.5		
							17.5	29.5	7.3	89.8	2.3	3.2						
							17.6	29.6	7.2	88.9	2.3	3.4						
					Middle	9.7	17.6	29.6	7.2	88.8	2.3	3.6						
							17.6	29.6	7.2	86.0	2.5	3.6						
							17.5	29.6	7.0	85.9	2.4	3.8						
28/03/14	1555-1615	23/Cloudy	Small Wave	19.8	Surface	1.0	19.0	27.1	27.1	7.3	7.4	92.1	2.3	3.4	2.5	3.5		
							18.9	27.1	7.4	92.4	2.3	3.2						
							18.9	27.2	7.2	90.3	2.5	3.6						
					Middle	9.9	18.8	27.3	7.2	89.9	2.6	3.4						
							18.7	27.3	6.9	86.6	2.5	3.6						
							18.7	27.4	6.8	85.8	2.5	3.8						
31/03/14	1157-1215	23/Rainy	Great Wave	19.6	Surface	1.0	18.4	26.3	26.4	7.4	7.4	89.5	3.0	4.0	2.9	4.1		
							18.3	26.4	7.4	89.1	3.1	4.0						
							18.5	27.9	7.3	88.9	2.8	3.6						
					Middle	9.3	18.5	27.4	7.3	88.8	2.8	3.8						
							18.6	27.5	7.1	85.5	2.9	4.2						
							18.5	27.4	7.1	85.4	2.9	4.0						

# Mid-Flood Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average		
03/03/14	1824-1844	18/Cloudy	Great Wave	18.8	Surface	17.1	29.1	7.2	7.2	93.7	2.4	2.4	3.6	3.7				
					Middle	17.1	29.2	7.1	7.1	92.8	2.7	2.7	3.6					
						17.2	29.3	7.1	7.1	92.6	2.6	2.6	3.8					
					Bottom	17.3	29.4	7.1	7.0	92.3	2.9	2.9	3.8					
						17.2	29.3	7.0	7.0	92.1	2.8	2.8	4.0					
					Surface	17.4	28.9	7.2	7.2	94.1	2.7	2.6	4.0					
05/03/14	0824-0844	17/Cloudy	Small Wave	19.6	Middle	17.3	29.0	7.1	7.0	93.4	3.1	3.1	4.0	4.0				
						17.3	29.0	7.1	7.0	92.5	3.1	3.1	4.0					
					Bottom	17.2	29.1	6.9	7.0	90.8	3.0	3.0	4.0					
						17.3	29.1	7.0	7.0	91.3	3.0	3.0	4.0					
					Surface	17.1	29.0	7.3	7.4	95.9	2.2	2.2	3.6					
						17.0	29.1	7.4	7.4	96.4	2.3	2.3	3.2					
Middle	17.1	29.2	7.3	7.3	95.0	2.5	2.5	3.6										
	17.2	29.1	7.2	7.3	94.9	2.5	2.5	3.4										
07/03/14	0936-0951	17/Cloudy	Small Wave	19.6	Bottom	17.2	29.3	7.2	7.2	94.6	2.7	2.7	3.8	3.5				
						17.3	29.4	7.2	7.2	94.3	2.6	2.6	3.6					
					Surface	17.0	29.3	7.2	7.2	87.7	2.5	2.4	4.0					
						17.1	29.1	7.2	7.2	87.1	2.4	2.4	3.6					
					Middle	17.4	29.5	7.1	7.1	86.1	2.7	2.7	3.8					
						17.2	29.4	7.1	7.1	86.2	2.7	2.7	4.0					
10/03/14	0844-0854	16/Cloudy	Small Wave	19.7	Bottom	17.3	29.4	7.0	7.0	85.4	2.8	2.8	4.0	3.9				
						17.2	29.4	7.0	7.0	85.6	2.8	2.8	4.2					
					Surface	17.5	29.4	7.4	7.4	97.1	2.2	2.2	3.5					
						17.5	29.4	7.4	7.4	97.2	2.2	2.2	3.2					
					Middle	17.6	29.4	7.3	7.3	95.8	2.3	2.3	3.4					
						17.6	29.4	7.3	7.3	95.6	2.3	2.3	3.4					
12/03/14	1500-1518	19/Cloudy	Small Wave	19.5	Bottom	17.6	29.5	7.1	7.1	92.6	2.5	2.5	3.6	3.5				
						17.6	29.5	7.1	7.1	92.2	2.5	2.5	3.6					
					Surface	17.3	29.3	7.5	7.5	93.2	2.2	2.2	3.6					
						17.3	29.3	7.6	7.5	93.8	2.2	2.2	3.6					
					Middle	17.4	29.4	7.4	7.4	91.7	2.3	2.3	3.4					
						17.5	29.3	7.4	7.4	91.5	2.3	2.3	3.4					
14/03/14	1624-1642	18/Cloudy	Small Wave	19.0	Bottom	17.5	29.5	7.3	7.3	90.5	2.4	2.4	3.8	3.6				
						17.5	29.6	7.3	7.3	90.6	2.4	2.4	3.6					
					Surface	17.3	29.5	7.2	7.2	89.1	3.1	3.1	4.4					
						17.2	29.4	7.2	7.2	89.3	3.2	3.2	4.4					
					Middle	17.3	29.6	7.1	7.1	87.9	3.5	3.4	4.6					
						17.3	29.5	7.0	7.1	87.3	3.4	3.4	4.4					
17/03/14	1754-1814	18/Cloudy	Small Wave	20.0	Bottom	17.4	29.6	6.7	6.6	82.8	3.5	3.5	4.6	4.5				
						17.4	29.6	6.6	6.6	82.0	3.5	3.5	4.8					
					Surface	17.1	29.5	7.2	7.2	89.1	3.1	3.1	4.4					
						17.2	29.4	7.2	7.2	89.3	3.2	3.2	4.4					
					Middle	17.3	29.6	7.1	7.1	87.9	3.5	3.4	4.6					
						17.3	29.5	7.0	7.1	87.3	3.4	3.4	4.4					
19/03/14	0829-0844	24/Cloudy	Small Wave	20.0	Bottom	16.7	26.2	7.2	7.2	86.6	2.7	2.7	3.8	3.7				
						16.7	26.2	7.2	7.2	86.3	2.7	2.7	3.8					
					Surface	17.1	26.1	7.3	7.3	88.0	2.4	2.4	3.6					
						17.1	26.1	7.3	7.3	88.1	2.4	2.4	3.4					
					Middle	16.9	26.2	7.2	7.2	87.0	2.7	2.6	3.8					
						16.8	26.2	7.3	7.2	87.4	2.6	2.6	3.6					
Bottom	16.7	26.2	7.2	7.2	86.6	2.7	2.7	3.8										
	16.7	26.1	7.2	7.2	86.3	2.7	2.7	3.8										

**Mid-Flood Tide**

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/14	0852-0904	21/Cloudy	Small Wave	20.4	Surface	1.0	16.8	26.0	26.1	7.2	87.3	2.4	2.4	3.6	3.6			
							16.9	26.1	26.2	7.3	87.8	2.4	3.6					
					Middle	10.2	16.8	26.2	26.2	7.4	88.7	2.6	2.6	3.8				
							16.8	26.1	26.2	7.4	89.0	2.7	3.8					
					Bottom	19.4	16.9	26.2	26.3	7.3	88.2	2.4	2.4	3.4				
							16.9	26.3	26.3	7.3	88.1	2.4	3.5					
24/03/14	1023-1043	22/Cloudy	Small Wave	20.2	Surface	1.0	17.3	26.2	26.2	7.2	87.6	2.3	2.4	3.5	3.5			
							17.2	26.1	26.2	7.2	87.8	2.4	3.4					
					Middle	10.1	17.2	26.2	26.2	7.1	86.5	2.9	2.9	3.8				
							17.2	26.2	26.2	7.0	85.8	2.9	3.9					
					Bottom	19.2	17.1	26.3	26.3	6.9	83.1	3.0	3.0	4.0				
							17.1	26.3	26.3	6.8	82.4	2.9	4.1					
26/03/14	1327-1344	21/Fine	Small Wave	19.6	Surface	1.0	17.6	29.5	29.5	7.4	91.1	2.2	2.2	3.6	3.6			
							17.5	29.4	29.5	7.4	90.8	2.2	3.6					
					Middle	9.8	17.6	29.5	29.5	7.3	90.3	2.3	2.3	3.4				
							17.6	29.5	29.5	7.3	89.9	2.3	3.3					
					Bottom	18.6	17.7	29.6	29.6	7.0	86.9	2.4	2.4	3.6				
							17.7	29.5	29.6	7.0	86.5	2.4	3.7					
28/03/14	0955-1015	23/Cloudy	Small Wave	19.8	Surface	1.0	19.0	27.1	27.1	7.4	92.9	2.2	2.3	3.4	3.5			
							19.1	27.1	27.1	7.4	92.4	2.3	3.2					
					Middle	9.9	19.0	27.2	27.2	7.3	90.9	2.3	2.4	3.4				
							18.9	27.2	27.2	7.2	90.6	2.4	3.5					
					Bottom	18.8	18.8	27.4	27.4	7.0	88.0	2.5	2.5	3.6				
							18.8	27.4	27.4	7.0	87.7	2.5	3.7					
31/03/14	1756-1815	23/Rainy	Great Wave	19.9	Surface	1.0	18.3	26.4	28.4	7.4	89.9	3.0	3.0	4.0	3.8			
							18.2	26.3	28.4	7.4	89.6	3.0	3.8					
					Middle	10.0	18.4	27.2	27.2	7.4	89.5	2.9	2.9	3.8				
							18.3	27.1	27.1	7.4	89.6	2.9	3.9					
					Bottom	18.9	18.4	27.5	27.5	7.1	86.5	2.9	2.9	4.0				
							18.4	27.4	27.4	7.1	86.1	2.9	3.7					

**Mid-Ebb Tide**

**Monitoring Station : M4a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
03/03/14	1348-1408	18/Cloudy	Great Wave	15.6	Surface	1.0	17.2	29.2	7.1	7.2	93.2	2.5	3.6	2.5	2.5	3.6	
							17.2	29.3	7.2	7.2	93.9	2.5	3.8				
							17.3	29.3	7.0	7.0	91.7	2.6	3.8				
05/03/14	1518-1538	17/Cloudy	Small Wave	16.4	Middle	8.2	17.2	29.2	7.0	7.0	91.9	2.7	3.8	2.7	2.7	3.8	
							17.4	29.4	7.0	7.0	91.4	2.5	3.5				
							17.4	29.5	7.0	7.0	91.8	2.4	3.4				
07/03/14	1627-1637	17/Cloudy	Small Wave	15.4	Surface	1.0	17.3	28.9	7.3	7.3	95.7	3.2	4.2	3.2	3.1	4.2	
							17.3	28.8	7.3	7.3	95.9	3.1	4.0				
							17.4	29.0	7.1	7.0	92.4	2.9	3.6				
10/03/14	1956-2011	17/Cloudy	Small Wave	15.7	Bottom	14.4	17.4	29.0	7.0	7.0	91.6	2.8	3.8	2.8	2.8	3.8	
							17.4	29.4	7.0	7.0	91.6	2.7	3.8				
							17.6	29.3	7.0	7.0	91.6	2.7	3.8				
12/03/14	0954-1012	18/Cloudy	Small Wave	15.7	Surface	1.0	17.5	29.5	7.0	7.0	85.5	2.7	3.6	2.7	2.7	3.6	
							17.6	29.7	7.0	7.0	85.4	2.8	3.8				
							17.4	29.8	6.9	6.9	84.3	2.9	4.0				
14/03/14	1018-1106	18/Cloudy	Small Wave	15.2	Middle	7.6	17.4	29.6	7.0	7.0	84.7	2.9	4.0	2.9	2.9	4.0	
							17.3	29.5	7.2	7.2	89.5	2.5	3.6				
							17.5	29.5	7.1	7.1	88.2	2.6	3.4				
17/03/14	1318-1338	19/Cloudy	Small Wave	16.0	Bottom	14.2	17.4	29.4	7.1	7.1	88.0	2.6	3.6	2.6	2.6	3.6	
							17.4	29.6	7.1	7.1	88.2	2.6	3.6				
							17.4	29.4	7.1	7.1	88.0	2.6	3.6				
19/03/14	1418-1438	24/Cloudy	Small Wave	16.8	Surface	1.0	17.4	29.4	7.2	7.2	90.1	3.1	4.0	3.1	3.2	4.0	
							17.3	29.5	7.2	7.2	89.2	3.2	4.2				
							17.4	29.5	7.0	7.0	86.9	3.1	4.0				
19/03/14	1418-1438	24/Cloudy	Small Wave	16.8	Middle	8.4	17.4	29.5	7.0	7.0	87.2	3.1	4.0	3.1	3.1	4.0	
							17.4	29.5	7.0	7.0	87.2	3.1	4.0				
							17.5	29.6	6.8	6.8	84.2	3.6	4.6				
19/03/14	1418-1438	24/Cloudy	Small Wave	16.8	Bottom	15.8	17.5	29.6	6.8	6.8	83.8	3.5	4.8	3.5	3.5	4.8	
							16.9	26.1	7.1	7.0	85.3	2.3	3.2				
							16.8	26.2	7.1	7.0	85.0	2.4	3.4				
19/03/14	1418-1438	24/Cloudy	Small Wave	16.8	Surface	1.0	16.7	26.2	7.1	7.1	85.7	2.8	3.6	2.8	2.8	3.6	
							16.8	26.2	7.0	7.0	84.6	2.1	3.0				
							16.7	26.2	7.1	7.1	85.4	2.8	3.7				

**Mid-Ebb Tide**

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average
21/03/14	1518-1536	21/Cloudy	Small Wave	16.8	Surface	1.0	16.8	26.2	7.1	7.1	85.8	2.3	3.2	2.3	3.3	3.2	3.3
							16.9	26.1	7.1	85.6	2.4	3.4					
					Middle	8.4	16.9	26.2	7.1	7.1	85.9	2.0	3.0	2.0	3.1	3.0	3.4
							16.8	26.3	7.0	85.1	2.1	3.2					
					Bottom	15.8	16.9	26.4	7.1	7.1	86.2	2.8	3.6	2.8	3.7	3.6	3.7
							16.9	26.3	7.1	85.5	2.8	3.8					
24/03/14	1814-1834	22/Cloudy	Small Wave	17.0	Surface	1.0	17.3	26.2	7.3	7.3	88.9	2.3	3.4	2.4	3.3	3.4	3.3
							17.3	26.2	7.3	89.3	2.4	3.2					
					Middle	8.5	17.2	26.2	7.1	7.1	86.7	2.8	3.8	2.8	3.9	3.8	3.6
							17.2	26.3	7.1	86.9	2.9	4.0					
					Bottom	16.0	17.2	26.3	7.0	7.1	84.9	2.6	3.6	2.6	3.7	3.6	3.7
							17.1	26.4	7.1	85.8	2.5	3.8					
26/03/14	0901-0917	21/Fine	Small Wave	15.8	Surface	1.0	17.6	29.5	7.1	7.1	87.7	2.4	3.4	2.3	3.5	3.4	3.5
							17.6	29.6	7.1	87.8	2.3	3.6					
					Middle	7.9	17.7	29.6	7.1	7.1	87.1	2.4	3.4	2.4	3.4	3.4	3.5
							17.6	29.6	7.0	86.8	2.4	3.4					
					Bottom	14.8	17.6	29.7	7.0	6.9	85.9	2.5	3.8	2.5	3.7	3.8	3.7
							17.7	29.6	6.9	85.5	2.5	3.6					
28/03/14	1625-1640	23/Cloudy	Small Wave	16.0	Surface	1.0	19.0	27.2	7.1	7.1	89.5	2.3	3.2	2.3	3.3	3.2	3.3
							19.0	27.2	7.2	89.7	2.3	3.4					
					Middle	8.0	18.9	27.3	7.1	7.1	88.5	2.5	3.6	2.5	3.5	3.6	3.5
							18.8	27.3	7.1	88.7	2.4	3.4					
					Bottom	15.0	18.8	27.5	7.0	6.9	87.2	2.5	3.8	2.5	3.7	3.8	3.7
							18.7	27.5	6.9	87.1	2.5	3.6					
31/03/14	1221-1240	23/Rainy	Great Wave	15.9	Surface	1.0	18.3	26.6	7.2	7.2	87.7	2.9	3.8	2.9	3.9	3.8	3.9
							18.4	26.6	7.2	87.6	2.9	4.0					
					Middle	7.5	18.4	27.3	7.2	7.2	87.7	2.8	3.6	2.8	3.7	3.6	3.8
							18.5	27.4	7.3	87.8	2.9	3.8					
					Bottom	14.9	18.6	27.7	7.1	7.1	86.5	2.8	4.0	2.8	3.9	3.8	3.9
							18.5	27.6	7.1	86.4	2.9	3.8					

**Mid-Flood Tide**

**Monitoring Station : M4a**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
03/03/14	1848-1908	18/Cloudy	Great Wave	15.4	Surface	17.1	29.2	7.0	7.1	92.0	2.5	2.6	3.6	3.5			
						17.2	29.1	92.7	2.6	3.4							
					Middle	17.2	29.2	6.9	6.9	90.4	2.7	2.8	3.6				
						17.3	29.3	6.9	6.9	90.8	2.8	2.8	3.8				
					Bottom	17.4	29.4	6.9	6.9	90.3	2.6	2.5	3.4				
						17.3	29.4	6.9	6.9	90.6	2.5	2.5	3.2				
05/03/14	0848-0908	17/Cloudy	Small Wave	17.0	Surface	17.4	29.0	7.3	7.4	95.9	2.5	2.5	3.4	3.5			
						17.3	29.0	7.4	7.4	96.7	2.5	2.5	3.6				
					Middle	17.4	29.0	7.2	7.2	95.0	3.3	3.3	4.2				
						17.4	29.0	7.2	7.2	94.6	3.3	3.3	4.1				
					Bottom	17.4	29.0	7.1	7.1	94.2	3.3	3.3	4.0				
						17.4	29.1	7.1	7.1	93.4	3.5	3.5	4.4				
07/03/14	0956-1013	17/Cloudy	Small Wave	15.8	Surface	17.1	29.1	7.1	7.1	93.0	2.4	2.4	3.2	3.4			
						17.1	29.1	7.2	7.2	94.4	2.4	2.4	3.6				
					Middle	17.2	29.2	7.3	7.1	95.0	2.6	2.6	3.4				
						17.3	29.3	7.1	7.1	92.8	2.6	2.6	3.8				
					Bottom	17.2	29.2	7.1	7.1	93.1	2.6	2.6	3.2				
						17.4	29.3	7.1	7.1	92.6	2.4	2.4	3.8				
10/03/14	0859-0913	16/Cloudy	Small Wave	16.1	Surface	17.4	29.3	7.1	7.1	92.9	2.3	2.3	3.4	3.3			
						17.3	29.3	7.1	7.1	86.5	2.6	2.6	3.8				
					Middle	17.3	29.2	7.1	7.1	86.4	2.6	2.6	3.6				
						17.1	29.4	7.0	7.0	85.5	2.8	2.8	3.6				
					Bottom	17.2	29.5	7.1	7.1	85.4	2.9	2.9	3.8				
						17.3	29.3	7.0	7.0	85.3	2.6	2.6	3.4				
12/03/14	1524-1542	19/Cloudy	Small Wave	15.9	Surface	17.2	29.2	7.0	7.0	85.4	2.6	2.6	3.6	3.5			
						17.5	29.4	7.2	7.2	94.3	2.3	2.3	3.4				
					Middle	17.5	29.4	7.2	7.2	94.4	2.3	2.3	3.2				
						17.5	29.4	7.2	7.2	93.9	2.4	2.4	3.4				
					Bottom	17.6	29.4	7.0	7.0	93.8	2.5	2.5	3.2				
						17.6	29.5	7.0	7.0	92.2	2.5	2.5	3.6				
14/03/14	1648-1706	18/Cloudy	Small Wave	15.4	Surface	17.4	29.4	7.5	7.5	92.5	2.3	2.3	3.2	3.3			
						17.3	29.3	7.5	7.5	92.4	2.3	2.3	3.4				
					Middle	17.4	29.4	7.3	7.3	90.1	2.5	2.5	3.6				
						17.5	29.5	7.3	7.3	90.5	2.5	2.5	3.4				
					Bottom	17.5	29.6	7.2	7.2	89.1	2.8	2.6	3.8				
						17.6	29.5	7.2	7.2	89.0	2.6	2.6	3.6				
17/03/14	1618-1638	18/Cloudy	Small Wave	16.8	Surface	17.3	29.4	7.3	7.4	90.9	2.9	2.9	3.8	3.9			
						17.4	29.4	7.4	7.4	91.5	2.9	2.9	4.0				
					Middle	17.3	29.6	7.1	7.1	88.4	3.2	3.2	4.2				
						17.4	29.5	7.2	7.2	89.2	3.2	3.2	4.2				
					Bottom	17.4	29.5	6.9	6.8	85.1	3.4	3.4	4.8				
						17.4	29.6	6.8	6.8	84.3	3.4	3.4	4.8				
19/03/14	0848-0908	24/Cloudy	Small Wave	17.0	Surface	17.1	26.1	7.2	7.2	86.7	2.3	2.2	3.2	3.3			
						17.1	26.1	7.2	7.2	86.7	2.3	2.2	3.4				
					Middle	16.8	26.1	7.0	7.0	84.6	2.0	2.0	3.0				
						16.9	26.1	7.1	7.0	85.0	2.0	2.0	3.2				
					Bottom	16.6	26.2	6.9	6.9	83.4	2.6	2.6	3.6				
						16.6	26.2	6.9	6.9	83.3	2.6	2.6	3.7				

**Mid-Flood Tide**

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Middle		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/14	0909-0921	21/Cloudy	Small Wave	17.2	Surface	1.0	16.8	26.1	26.1	7.1	86.5	2.2	3.2	2.3	3.3	3.4		
					Middle	8.6	16.8	26.0	7.1	86.2	2.3	3.4						
					Bottom	16.2	16.7	26.2	7.1	86.5	1.9	3.0						
							16.8	26.3	7.2	86.8	2.0	3.2						
							16.9	26.2	7.2	86.5	2.7	3.8						
							17.3	26.1	7.3	89.9	2.7	3.6						
24/03/14	1047-1102	22/Cloudy	Small Wave	17.8	Surface	1.0	17.3	26.1	26.2	7.4	90.2	2.4	3.2	2.7	3.7	3.6		
					Middle	8.9	17.2	26.3	6.9	84.5	2.7	3.6						
					Bottom	16.8	17.2	26.3	7.0	85.3	2.6	3.8						
							17.0	26.4	6.8	81.8	2.9	3.8						
							17.0	26.4	6.7	81.1	2.9	4.0						
							17.6	29.5	7.2	88.6	2.3	3.4						
26/03/14	1350-1406	21/Fine	Small Wave	16.0	Surface	1.0	17.6	29.5	29.5	7.2	88.5	2.3	3.4	2.4	3.5	3.6		
					Middle	8.0	17.6	29.5	7.1	88.1	2.4	3.6						
					Bottom	15.0	17.7	29.5	7.2	88.2	2.4	3.4						
							17.7	29.5	7.0	86.5	2.5	3.6						
							17.6	29.4	7.0	86.9	2.5	3.8						
							19.0	27.1	7.2	90.1	2.3	3.4						
28/03/14	1025-1040	23/Cloudy	Small Wave	16.0	Surface	1.0	19.1	27.2	27.2	7.2	90.4	2.3	3.3	2.3	3.3	3.4		
					Middle	8.0	19.0	27.2	7.0	88.0	2.3	3.4						
					Bottom	15.0	18.9	27.3	7.1	88.5	2.2	3.2						
							18.8	27.4	6.9	86.8	2.5	3.6						
							18.8	27.5	6.9	86.1	2.5	3.4						
							18.2	26.5	7.2	87.3	2.9	4.2						
31/03/14	1822-1837	23/Rainy	Great Wave	16.3	Surface	1.0	18.3	26.6	26.6	7.2	87.4	2.9	4.1	2.9	3.9	4.0		
					Middle	8.2	18.4	27.3	7.2	87.6	2.8	3.8						
					Bottom	15.3	18.3	27.2	7.2	87.2	2.8	4.0						
							18.4	27.2	7.1	86.1	2.9	4.0						
							18.4	27.6	7.1	86.1	2.9	4.0						
							18.5	27.6	7.1	86.4	2.9	4.2						

**Mid-Ebb Tide**

**Monitoring Station : M5**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)	
					Value	Ave.		Value	Average	Depth-average	Value	Average	Value	Depth-average	Value
03/03/14	1412-1432	18/Cloudy	Great Wave	13.6	Surface	1.0	17.2	29.2	7.2	94.0	2.2	3.2	2.3	3.6	
					Middle	6.8	17.1	29.1	7.2	94.2	2.1	3.4			
					Bottom	12.6	17.2	29.3	7.2	93.8	2.3	3.6			
						17.4	29.4	7.2	93.5	2.4	3.6				
						17.4	29.5	7.2	94.2	2.6	3.7				
						17.4	29.4	7.2	94.6	2.6	3.7				
05/03/14	1542-1602	17/Cloudy	Small Wave	14.0	Surface	1.0	17.3	28.8	7.2	94.2	2.5	3.8	2.8	4.1	
					Middle	7.0	17.3	28.8	7.2	94.7	2.5	3.8			
					Bottom	13.0	17.4	28.9	7.2	93.7	3.0	4.0			
						17.4	28.9	7.2	94.1	3.0	4.2				
						17.4	29.0	7.0	91.9	2.8	3.8				
						17.4	29.0	7.0	92.0	2.9	3.6				
07/03/14	1642-1702	17/Cloudy	Small Wave	14.0	Surface	1.0	17.4	29.4	7.1	92.9	2.1	3.0	2.3	3.3	
					Middle	6.9	17.3	29.6	7.1	93.4	2.1	3.0			
					Bottom	13.0	17.5	29.5	7.0	91.9	2.3	3.4			
						17.4	29.4	7.1	92.1	2.3	3.2				
						17.5	29.6	7.1	93.0	2.6	3.6				
						17.4	29.5	7.1	92.7	2.6	4.0				
10/03/14	2018-2032	17/Cloudy	Small Wave	13.3	Surface	1.0	17.4	29.4	7.0	85.4	2.3	3.3	2.5	3.7	
					Middle	6.7	17.5	29.7	7.0	85.7	2.4	3.2			
					Bottom	12.3	17.4	29.8	7.0	85.6	2.5	3.6			
						17.7	29.5	7.1	86.2	2.6	3.8				
						17.6	29.6	7.1	86.4	2.6	4.0				
						17.5	29.4	7.2	93.9	2.2	3.2				
12/03/14	1018-1036	18/Cloudy	Small Wave	13.8	Surface	1.0	17.5	29.5	7.2	94.0	2.2	3.1	2.4	3.5	
					Middle	6.9	17.5	29.5	7.1	92.5	2.4	3.4			
					Bottom	12.8	17.5	29.5	7.1	92.4	2.4	3.6			
						17.6	29.5	6.9	90.3	2.6	3.8				
						17.5	29.5	6.9	90.1	2.6	3.6				
						17.3	29.4	7.5	92.6	2.1	3.0				
14/03/14	1112-1130	18/Cloudy	Small Wave	13.4	Surface	1.0	17.4	29.5	7.5	92.7	2.1	2.1	2.3	3.3	
					Middle	6.7	17.5	29.5	7.4	91.2	2.3	3.4			
					Bottom	12.4	17.4	29.5	7.4	91.1	2.3	3.2			
						17.5	29.6	7.2	89.0	2.5	3.6				
						17.6	29.5	7.2	88.8	2.5	3.6				
						17.3	29.5	7.3	90.2	2.6	3.7				
17/03/14	1342-1402	19/Cloudy	Small Wave	14.0	Surface	1.0	17.3	29.5	7.2	89.2	2.5	3.5	3.3	4.3	
					Middle	7.0	17.4	29.5	7.1	88.3	3.7	4.6			
					Bottom	13.0	17.4	29.5	7.2	89.0	3.6	4.8			
						17.4	29.5	6.7	82.5	3.7	4.8				
						17.5	29.6	6.6	82.2	3.7	4.8				
						17.2	26.2	7.5	90.3	2.1	3.2				
19/03/14	1442-1502	24/Cloudy	Small Wave	14.8	Surface	1.0	17.1	26.3	7.5	90.5	2.1	3.3	2.0	3.1	
					Middle	7.4	17.0	26.3	7.9	95.0	2.0	3.0			
					Bottom	13.8	16.8	26.4	7.9	94.3	2.0	3.0			
						16.8	26.4	7.9	94.9	2.0	3.1				
						16.8	26.4	7.8	94.3	2.0	3.2				
						16.8	26.4	7.8	94.6	2.0	3.1				



**Mid-Ebb Tide**

**Monitoring Station : M5**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)	
					Surface	Bottom	Value	Ave.	Value	Average	Depth-average	Value	Average	Value	Depth-average	
21/03/14	1540-1600	21/Cloudy	Small Wave	15.2	Surface	1.0	16.8	26.1	7.5	7.5	90.8	2.1	3.0	2.0	3.0	3.1
							16.8	26.0	7.5	7.5	91.1	2.1	3.2			
							16.8	26.1	7.8	7.9	95.6	2.0	3.0			
							16.9	26.2	7.8	7.9	94.8	1.9	2.8			
							16.9	26.2	7.9	7.9	95.4	1.9	3.0			
							16.8	26.3	7.9	7.9	95.1	2.0	3.2			
24/03/14	1838-1858	22/Cloudy	Small Wave	16.2	Surface	1.0	17.3	26.2	7.1	7.1	86.9	2.5	3.4	2.4	3.4	3.5
							17.3	26.2	7.0	7.0	86.2	2.4	3.6			
							17.2	26.3	7.0	6.9	84.8	2.0	2.8			
							17.3	26.3	6.9	6.9	84.3	2.0	3.0			
							17.1	26.3	6.8	6.8	82.3	2.8	3.6			
							17.1	26.4	6.8	6.8	82.7	2.8	4.0			
26/03/14	0923-0938	21/Fine	Small Wave	14.0	Surface	1.0	17.6	29.5	7.2	7.2	89.1	2.1	3.2	2.2	3.2	3.3
							17.6	29.5	7.2	7.2	88.8	2.1	3.4			
							17.5	29.6	7.1	7.1	87.9	2.2	3.2			
							17.6	29.5	7.1	7.1	87.6	2.2	3.4			
							17.6	29.6	7.0	7.0	86.5	2.4	3.4			
							17.6	29.6	7.0	7.0	86.1	2.4	3.6			
28/03/14	1645-1700	23/Cloudy	Small Wave	14.2	Surface	1.0	19.0	27.1	7.2	7.2	89.9	2.2	3.2	2.2	3.2	3.1
							19.0	27.1	7.2	7.2	90.1	2.2	3.0			
							18.9	27.3	7.1	7.1	89.2	2.2	3.2			
							18.8	27.4	7.1	7.1	88.6	2.1	3.4			
							18.8	27.5	6.9	6.9	86.8	2.3	3.4			
							18.8	27.5	6.9	6.9	86.3	2.4	3.6			
31/03/14	1248-1305	23/Rainly	Great Wave	14.1	Surface	1.0	18.2	26.4	7.3	7.3	88.5	2.9	4.2	2.8	4.2	4.1
							18.1	26.2	7.4	7.4	89.1	2.9	4.0			
							18.4	27.1	7.2	7.2	87.7	2.7	3.6			
							18.5	27.0	7.3	7.3	87.8	2.8	3.6			
							18.6	27.6	7.1	7.1	85.8	2.8	3.8			
							18.5	27.7	7.1	7.1	85.5	2.8	4.0			

# Mid-Flood Tide

Monitoring Station : M5


Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)										
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average								
03/03/14	1912-1932	18/Cloudy	Great Wave	13.2	Surface	17.2	29.2	29.2	7.1	92.9	93.1	2.2	2.2	3.2	3.1	3.4	3.0	3.0							
						17.1	29.2	29.2	7.1	93.2	92.6	2.2	2.2	3.0											
					Middle	17.3	29.3	29.4	7.1	92.7	92.6	2.4	2.4	3.4					3.3	2.4	3.3	3.4	3.3	3.3	
						17.3	29.4	29.4	7.1	92.4	92.6	2.4	2.4	3.2					3.3						
					Bottom	17.3	29.4	29.4	7.1	93.1	93.3	2.7	2.7	3.6					3.7	2.7	3.7	3.6	3.6	3.6	3.6
						17.4	29.3	29.3	7.1	93.5	93.3	2.7	2.7	3.8					3.7						
05/03/14	0912-0932	17/Cloudy	Small Wave	14.8	Surface	17.3	29.0	29.0	7.2	94.2	94.5	2.1	2.0	3.2	3.1	3.6	3.0	3.0							
						17.3	28.9	29.0	7.2	94.7	92.6	2.0	2.0	3.0					3.0						
					Middle	17.4	29.0	29.1	7.1	92.4	92.6	2.8	2.9	3.6					3.7	2.7	3.7	3.6	3.6	3.6	
						17.4	29.1	29.1	7.1	92.8	92.6	2.9	2.9	3.8					3.7						
					Bottom	17.4	29.1	29.1	7.0	91.9	93.6	3.1	3.2	4.0					4.1	3.2	4.1	4.0	4.1	4.0	4.0
						17.4	29.1	29.1	7.1	95.3	93.6	3.2	3.2	4.2					4.2						
07/03/14	1019-1036	17/Cloudy	Small Wave	14.2	Surface	17.2	29.1	29.1	7.3	95.1	95.3	2.1	2.0	3.0	3.0	3.3	3.0	3.0							
						17.2	29.1	29.1	7.3	95.4	94.8	2.0	2.0	3.0					3.0						
					Middle	17.2	29.2	29.3	7.2	94.9	94.8	2.2	2.2	3.4					3.3	2.3	3.3	3.4	3.3	3.3	
						17.1	29.3	29.3	7.2	94.6	94.8	2.3	2.2	3.2					3.3						
					Bottom	17.4	29.4	29.4	7.3	95.3	95.2	2.5	2.5	3.4					3.6	2.5	3.6	3.4	3.6	3.4	3.4
						17.5	29.3	29.3	7.3	95.0	95.2	2.5	2.5	3.8					3.8						
10/03/14	0920-0935	16/Cloudy	Small Wave	13.7	Surface	17.2	29.1	29.1	7.1	86.5	86.6	2.4	2.3	3.2	3.3	3.5	3.0	3.0							
						17.1	29.1	29.1	7.1	86.6	86.2	2.3	2.4	3.4					3.5						
					Middle	17.3	29.4	29.4	7.1	86.2	86.2	2.4	2.4	3.4					3.5	2.4	3.5	3.4	3.5	3.5	
						17.1	29.3	29.3	7.1	86.1	87.0	2.4	2.5	3.6					3.7						
					Bottom	17.4	29.2	29.3	7.1	86.8	87.0	2.5	2.5	3.6					3.7	2.5	3.7	3.6	3.7	3.6	3.6
						17.3	29.3	29.3	7.2	87.1	87.0	2.5	2.5	3.8					3.8						
12/03/14	1548-1606	19/Cloudy	Small Wave	14.0	Surface	17.5	29.4	29.4	7.3	95.9	96.0	2.1	2.1	3.0	3.1	3.3	3.0	3.0							
						17.5	29.4	29.4	7.3	96.0	94.6	2.1	2.2	3.2					3.3						
					Middle	17.6	29.4	29.4	7.2	94.5	94.6	2.2	2.2	3.2					3.3	2.2	3.3	3.2	3.3	3.3	
						17.5	29.4	29.4	7.2	94.6	94.6	2.2	2.2	3.4					3.4						
					Bottom	17.5	29.5	29.5	7.0	92.1	92.2	2.3	2.3	3.4					3.4	2.3	3.4	3.4	3.4	3.4	3.4
						17.5	29.5	29.5	7.0	92.2	92.2	2.3	2.3	3.4					3.4						
14/03/14	1712-1730	18/Cloudy	Small Wave	13.6	Surface	17.4	29.4	29.5	7.5	93.6	93.7	2.0	2.0	3.0	3.1	3.3	3.0	3.0							
						17.4	29.5	29.5	7.6	93.7	92.1	2.1	2.1	3.2					3.2						
					Middle	17.5	29.5	29.5	7.4	92.1	92.1	2.2	2.3	3.2					3.3	2.2	3.3	3.2	3.3	3.3	
						17.6	29.4	29.4	7.4	92.0	92.0	2.3	2.3	3.4					3.4						
					Bottom	17.6	29.5	29.6	7.3	89.9	89.9	2.4	2.4	3.6					3.5	2.4	3.5	3.6	3.5	3.4	3.4
						17.5	29.6	29.6	7.3	89.8	89.9	2.4	2.4	3.4					3.4						
17/03/14	1842-1902	18/Cloudy	Small Wave	14.8	Surface	17.3	29.4	29.4	7.4	92.2	92.0	2.8	2.9	3.8	3.8	4.2	3.8	3.8							
						17.3	29.4	29.4	7.4	91.8	87.1	2.9	3.2	4.2					4.1						
					Middle	17.4	29.5	29.5	7.0	86.8	87.1	3.2	3.2	4.2					4.1	3.2	4.1	4.2	4.2	4.2	
						17.4	29.5	29.5	7.0	87.3	87.1	3.3	3.3	4.0					4.1						
					Bottom	17.4	29.5	29.6	7.0	86.3	86.5	3.6	3.5	4.6					4.6	3.5	4.6	4.6	4.6	4.6	
						17.4	29.6	29.6	7.0	86.7	86.5	3.5	3.5	4.6					4.6						
19/03/14	0918-0935	24/Cloudy	Small Wave	15.2	Surface	17.2	26.1	26.2	7.2	87.1	87.2	2.0	2.0	3.0	3.1	3.2	3.0	3.0							
						17.1	26.2	26.2	7.2	87.2	87.2	2.0	2.0	3.2					3.2						
					Middle	17.0	26.2	26.2	7.0	84.7	84.8	2.2	2.2	3.4					3.3	2.1	3.3	3.4	3.3	3.2	
						16.9	26.1	26.1	7.0	84.8	84.8	2.1	2.1	3.2					3.2						
					Bottom	16.9	26.2	26.3	6.8	82.3	82.4	2.3	2.3	3.4					3.3	2.3	3.3	3.4	3.3	3.2	
						16.9	26.3	26.3	6.9	82.5	82.4	2.3	2.3	3.2					3.2						

**Mid-Flood Tide**


**Monitoring Station : M5**

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/14	0926-0938	21/Cloudy	Small Wave	15.4	Surface	16.8	26.1	7.6	91.5	2.0	3.0	1.9	3.0	3.0			
						16.7	26.1	7.6	91.7	2.1	3.2						
					Middle	16.8	26.3	8.0	96.2	1.9	3.0						
						16.9	26.3	7.9	95.5	1.8	2.8						
					Bottom	16.9	26.3	8.0	96.1	1.9	3.0						
						16.8	26.4	7.9	95.6	1.9	3.0						
24/03/14	1110-1130	22/Cloudy	Small Wave	16.8	Surface	17.3	26.2	7.2	88.7	2.0	3.0	2.5	3.0	3.4			
						17.2	26.2	7.2	88.3	2.0	2.8						
					Middle	17.2	26.3	7.0	85.4	2.6	3.6						
						17.2	26.3	7.0	85.9	2.6	3.4						
					Bottom	17.1	26.4	6.9	83.0	3.0	3.8						
						17.1	26.4	6.9	83.4	3.0	4.0						
26/03/14	1412-1432	21/Fine	Small Wave	14.2	Surface	17.5	29.5	7.3	90.2	2.1	3.2	2.2	3.0	3.3			
						17.5	29.4	7.3	90.0	2.1	3.0						
					Middle	17.6	29.4	7.2	89.2	2.2	3.4						
						17.5	29.5	7.2	88.8	2.2	3.2						
					Bottom	17.5	29.5	7.1	87.1	2.3	3.4						
						17.5	29.6	7.0	86.8	2.3	3.6						
28/03/14	1045-1100	23/Cloudy	Small Wave	14.2	Surface	19.0	27.1	7.2	90.7	2.1	2.8	2.2	2.8	3.2			
						19.0	27.1	7.2	90.1	2.1	3.0						
					Middle	18.9	27.2	7.1	88.9	2.2	3.2						
						18.9	27.2	7.0	88.4	2.2	3.4						
					Bottom	18.8	27.4	7.0	88.0	2.3	3.4						
						18.8	27.4	7.0	87.2	2.4	3.6						
31/03/14	1845-1904	23/Rainy	Great Wave	14.6	Surface	18.1	26.4	7.3	89.9	2.9	4.0	2.8	4.0	3.7			
						18.0	26.3	7.4	89.5	2.9	3.8						
					Middle	18.3	27.1	7.3	87.9	2.7	3.6						
						18.4	27.3	7.3	87.8	2.7	3.8						
					Bottom	18.5	27.6	7.1	86.1	2.8	3.6						
						18.4	27.5	7.1	86.4	2.8	3.6						

## Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

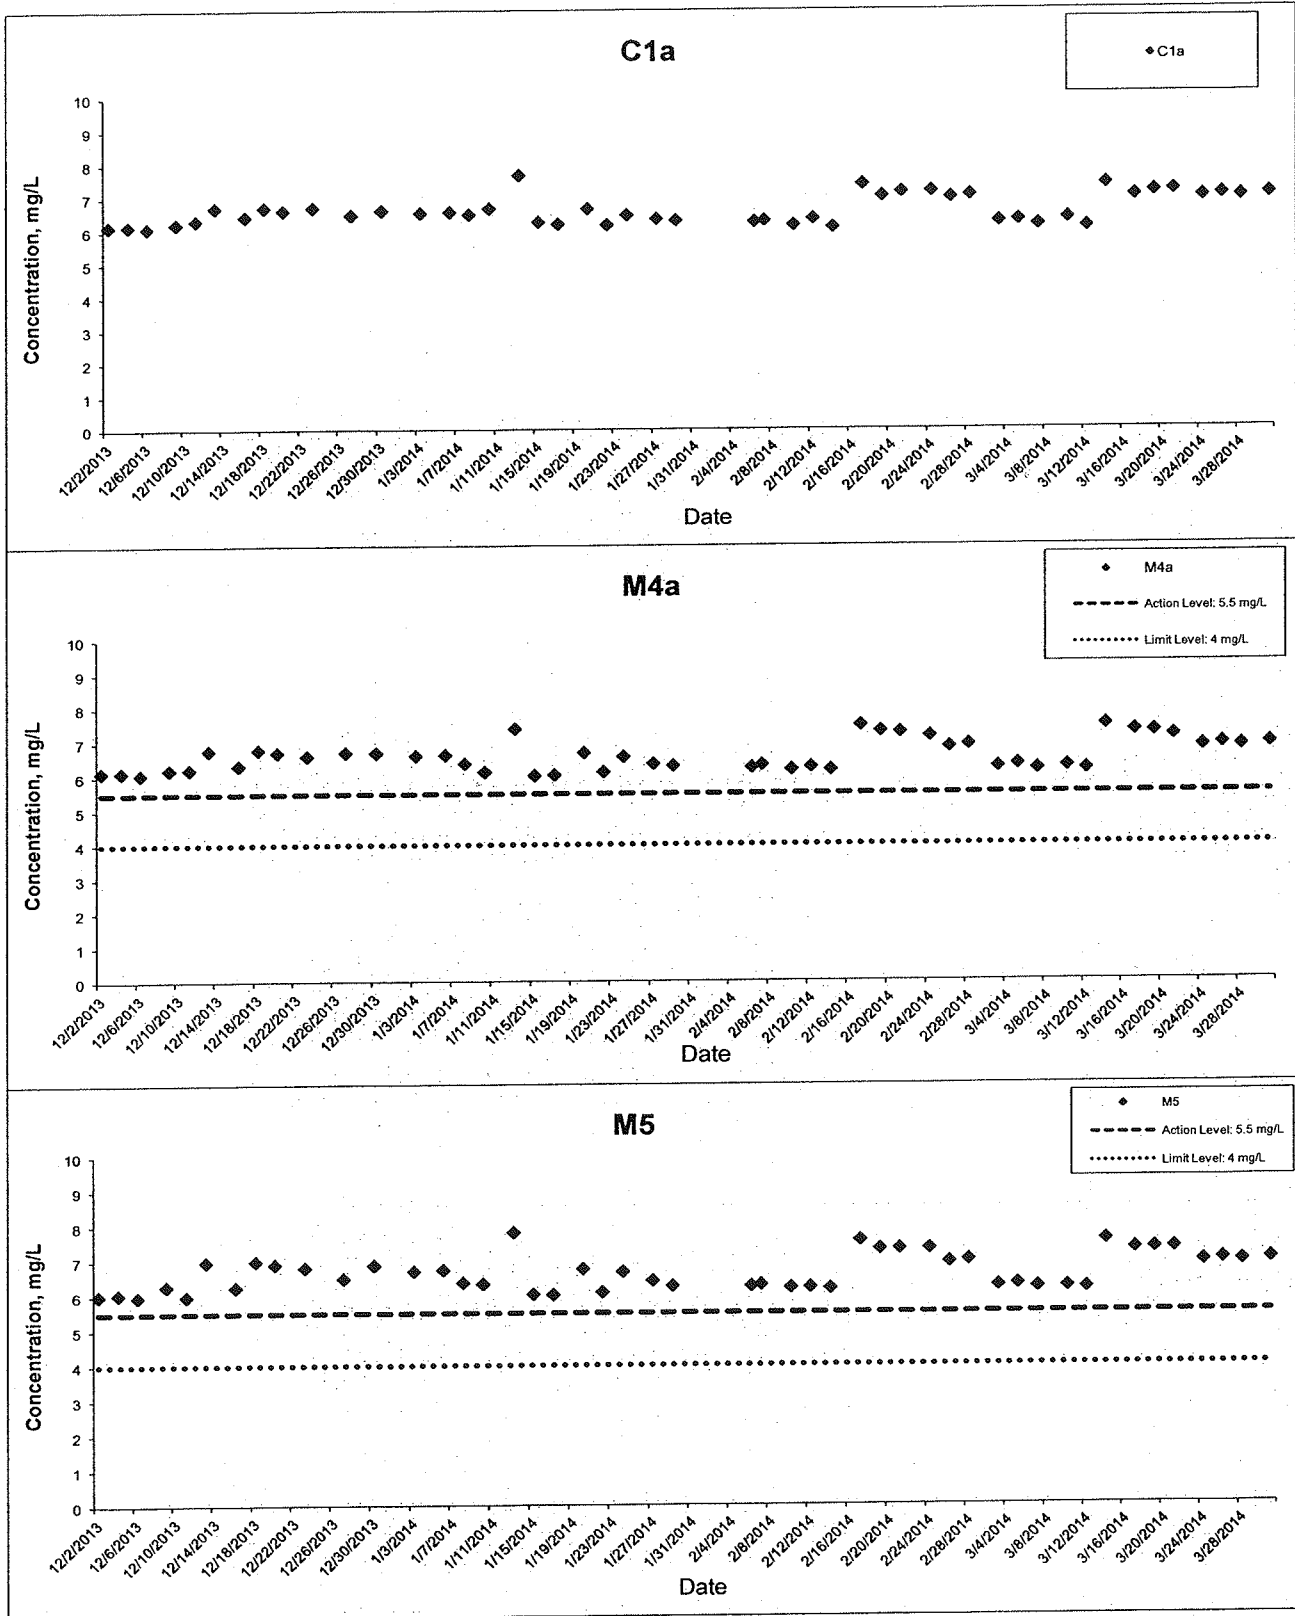

## Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

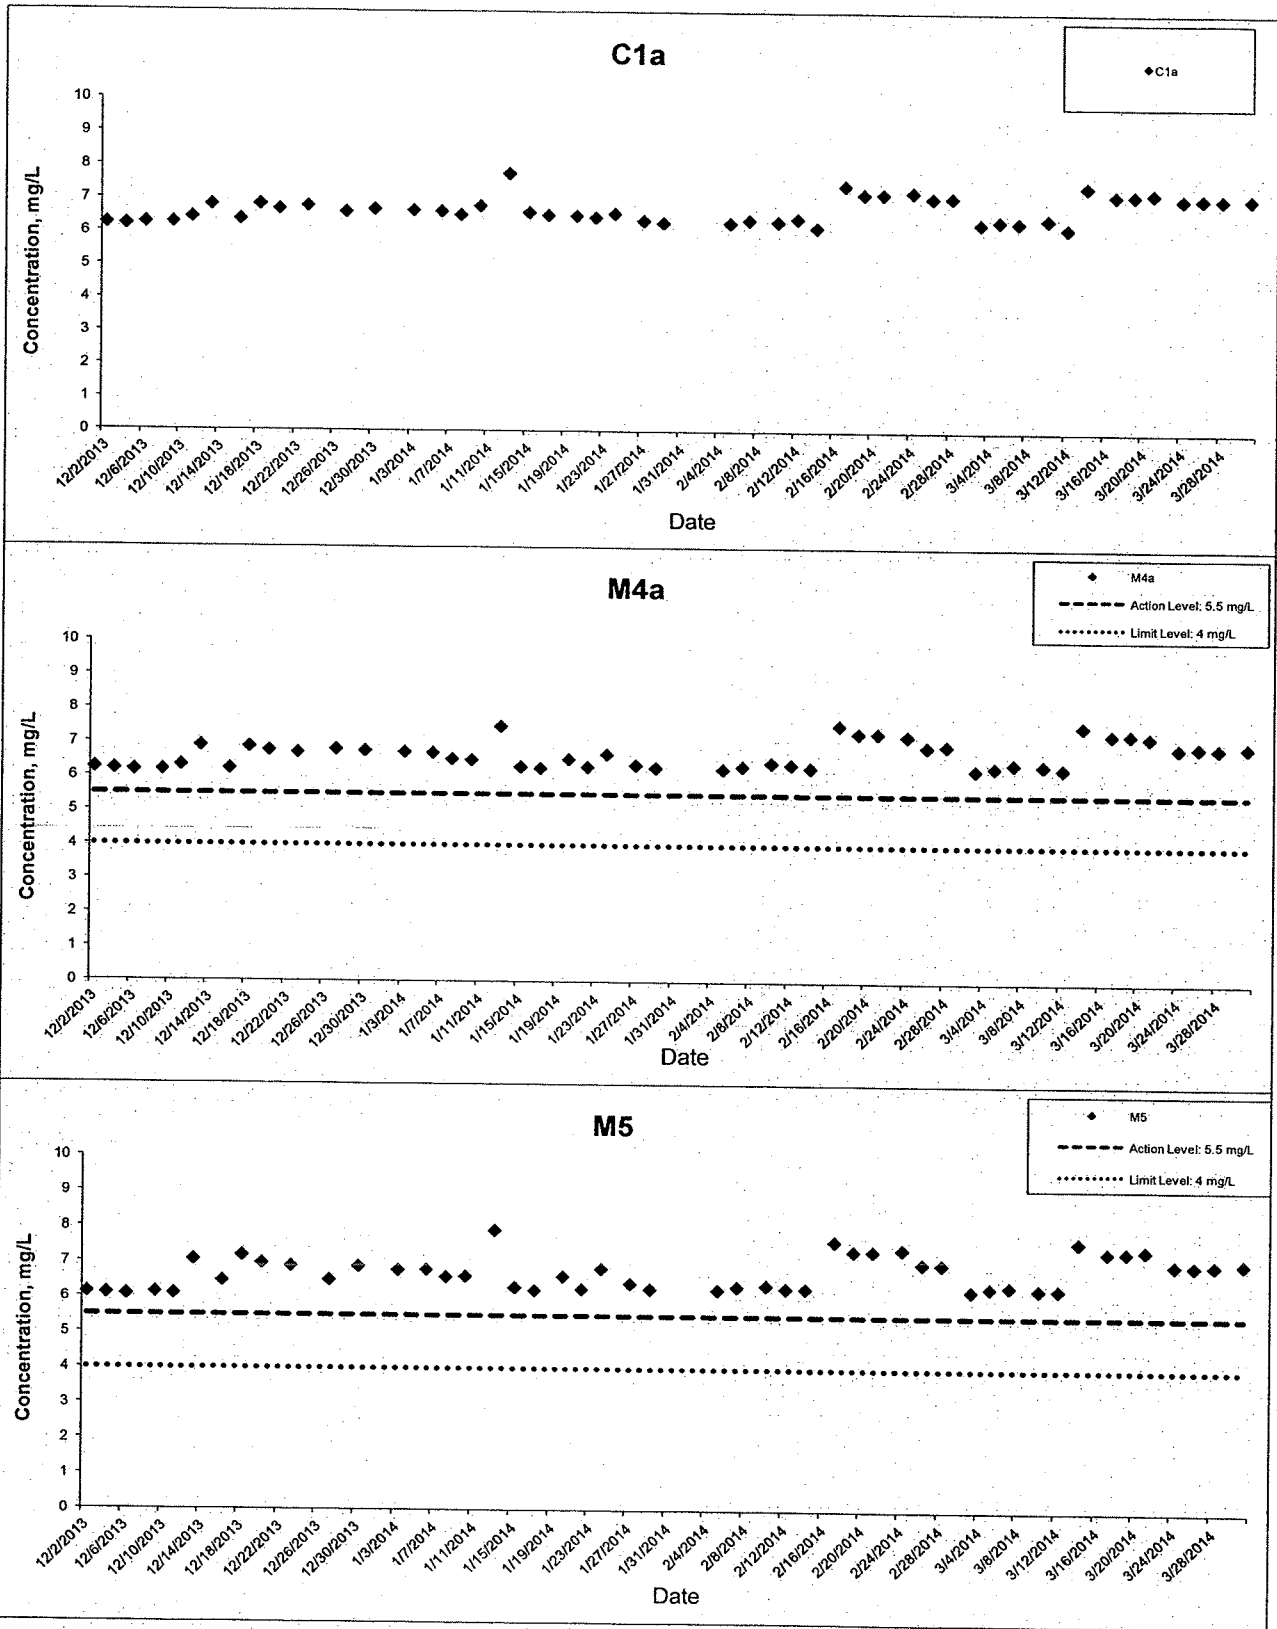




The Client shall be responsible for the use of the information provided in this report. The Client shall be responsible for the use of the information provided in this report. The Client shall be responsible for the use of the information provided in this report.

HONG KONG - ZHUHAI - MACAO BRIDGE  
 HONG KONG BOUNDARY CROSSING FACILITIES  
 - RECLAMATION WORKS




Graphical Presentation of Impact Water Quality  
 Monitoring Results



### Dissolved Oxygen (Bottom) at Mid-Ebb Tide

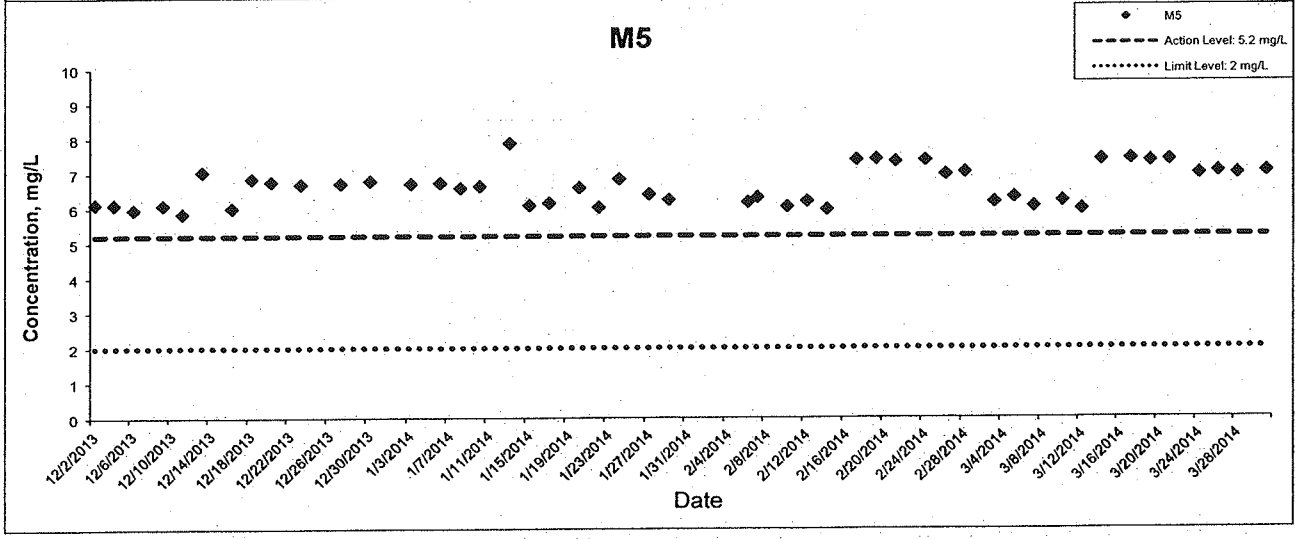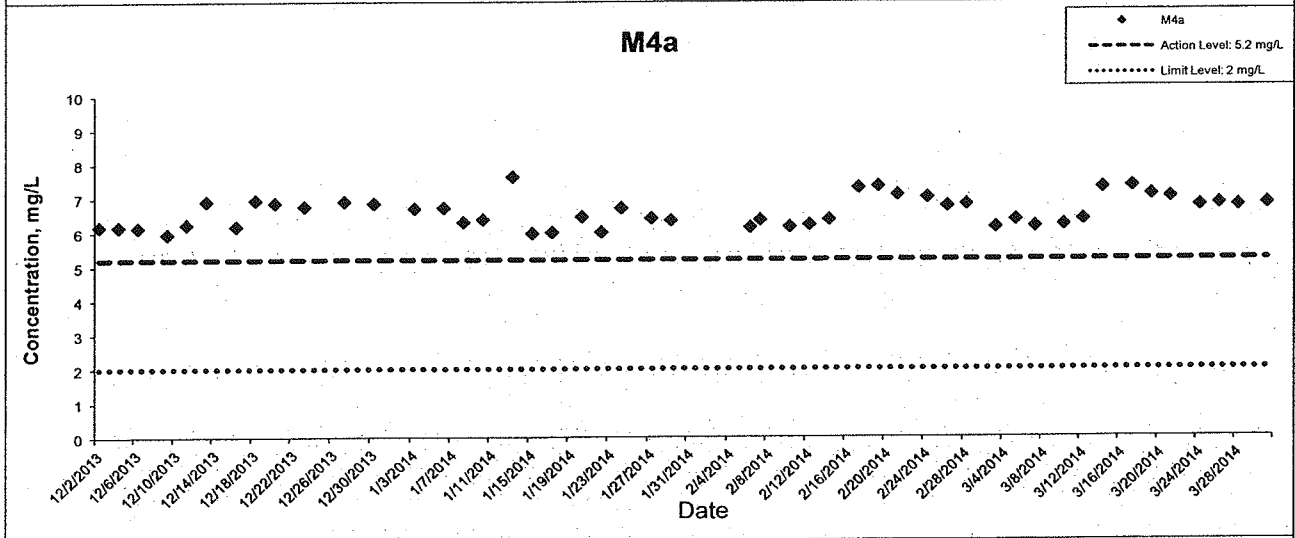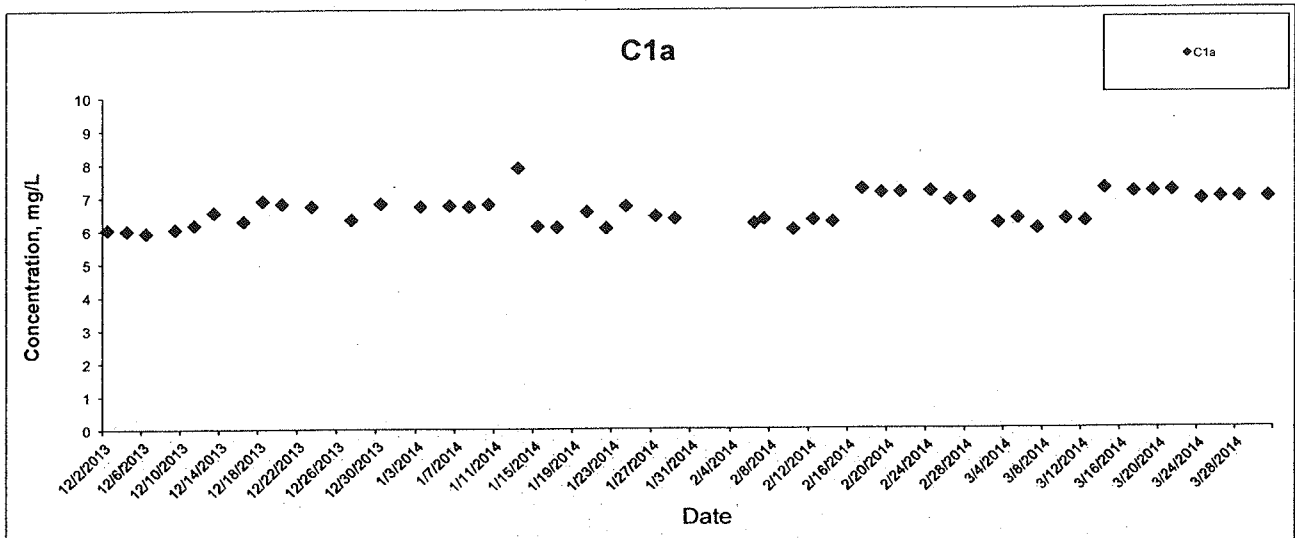

### Dissolved Oxygen (Bottom) at Mid-Flood Tide

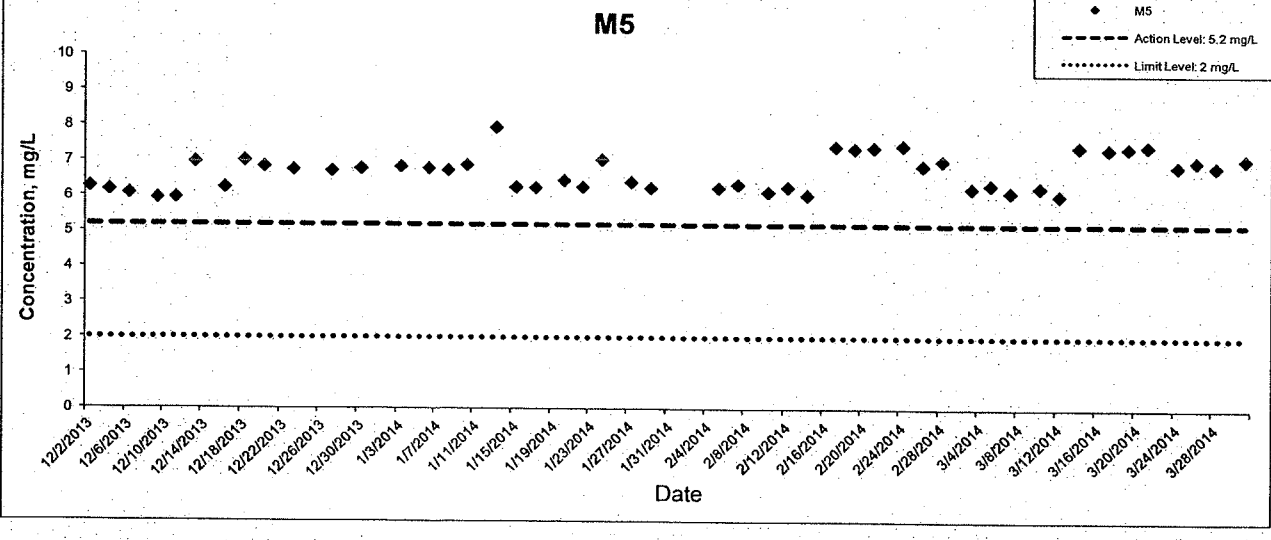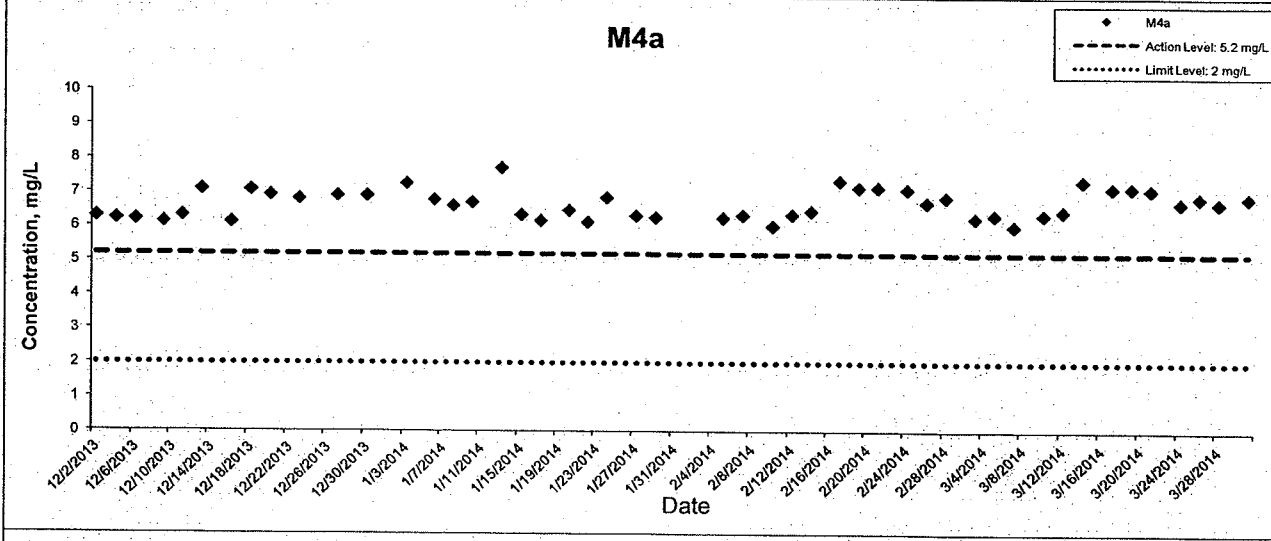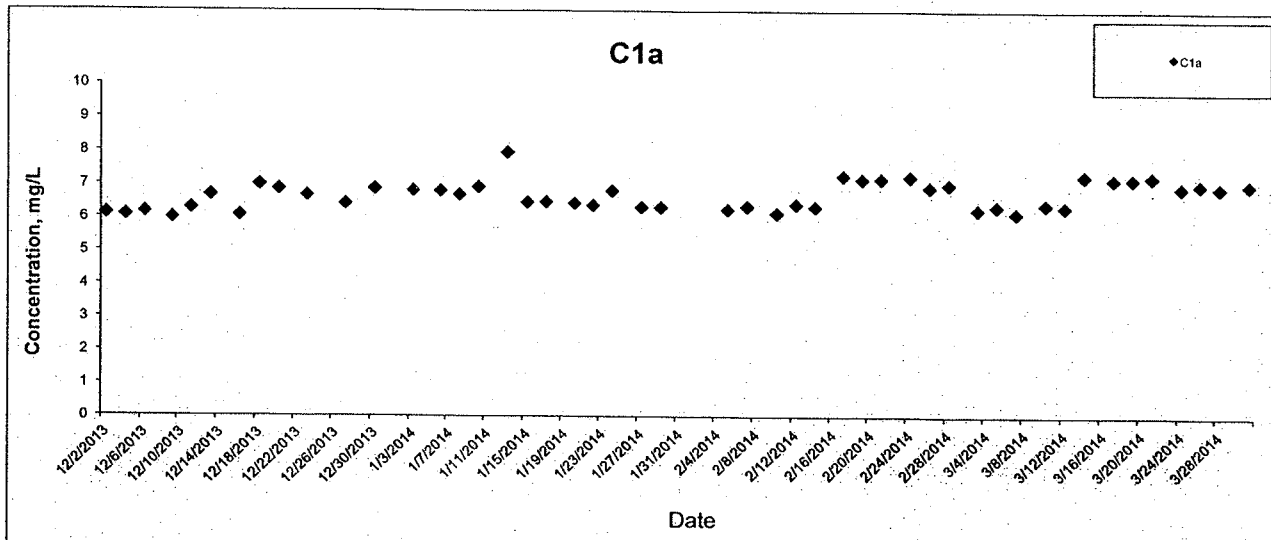

For Distribution only - prepared for the use of the Client. It is not to be used for any other purpose without the prior written consent of AECOM. All rights reserved. AECOM and the AECOM logo are registered trademarks and service marks of AECOM Technology Corporation. All other marks, logos, and symbols are the property of their respective owners.

HONG KONG - ZHUHAI - MACAO BRIDGE  
 HONG KONG BOUNDARY CROSSING FACILITIES  
 - RECLAMATION WORKS

### Graphical Presentation of Impact Water Quality Monitoring Results






Project No.: 60249820

Date: April 2014




Appendix C

### Turbidity at Mid-Ebb Tide

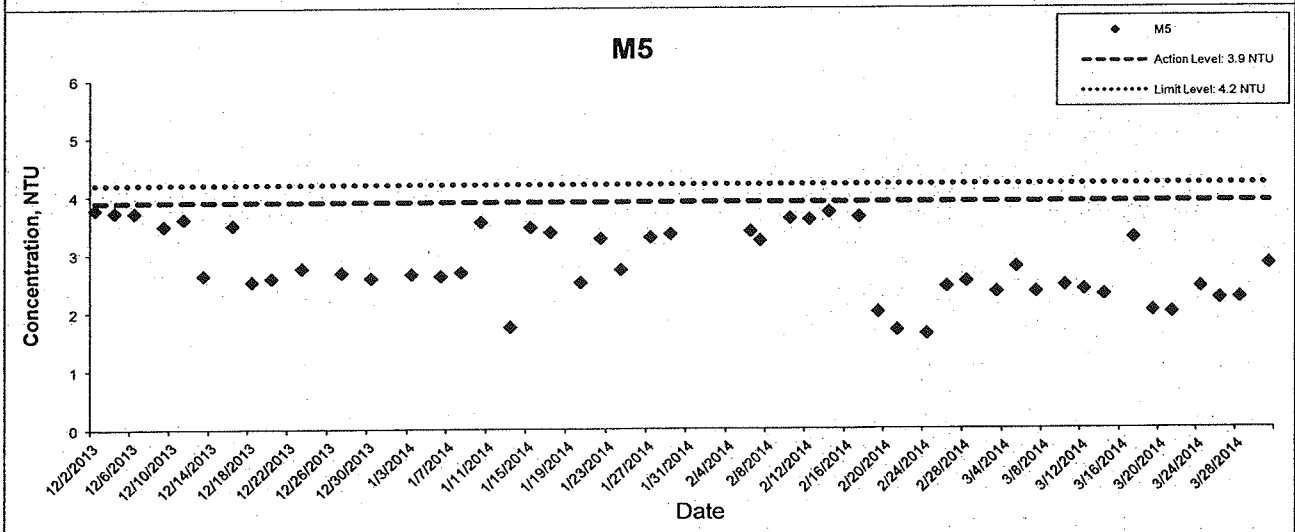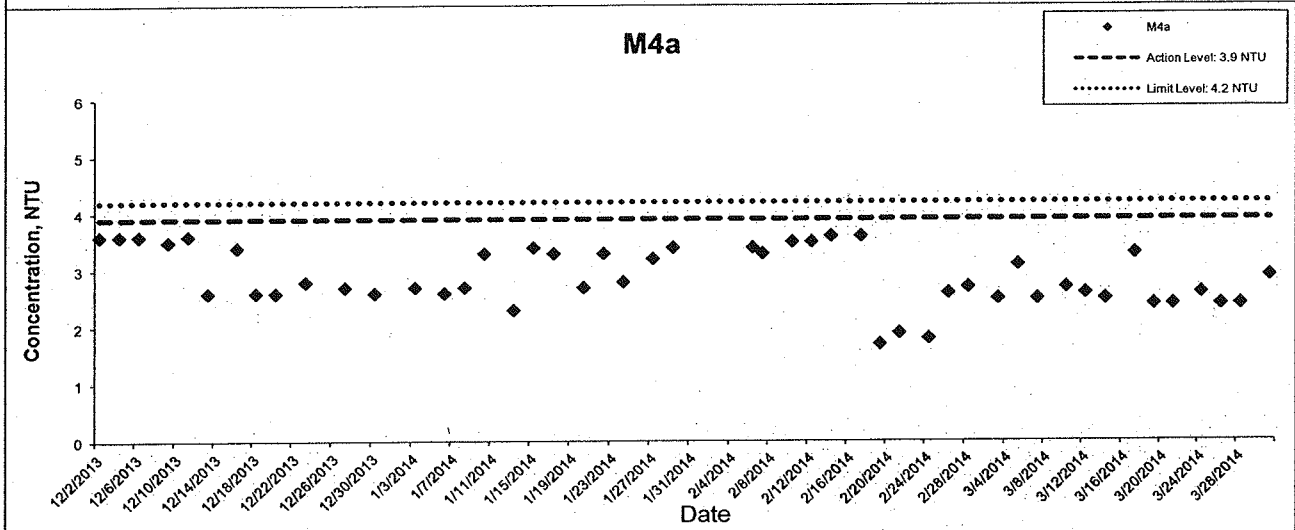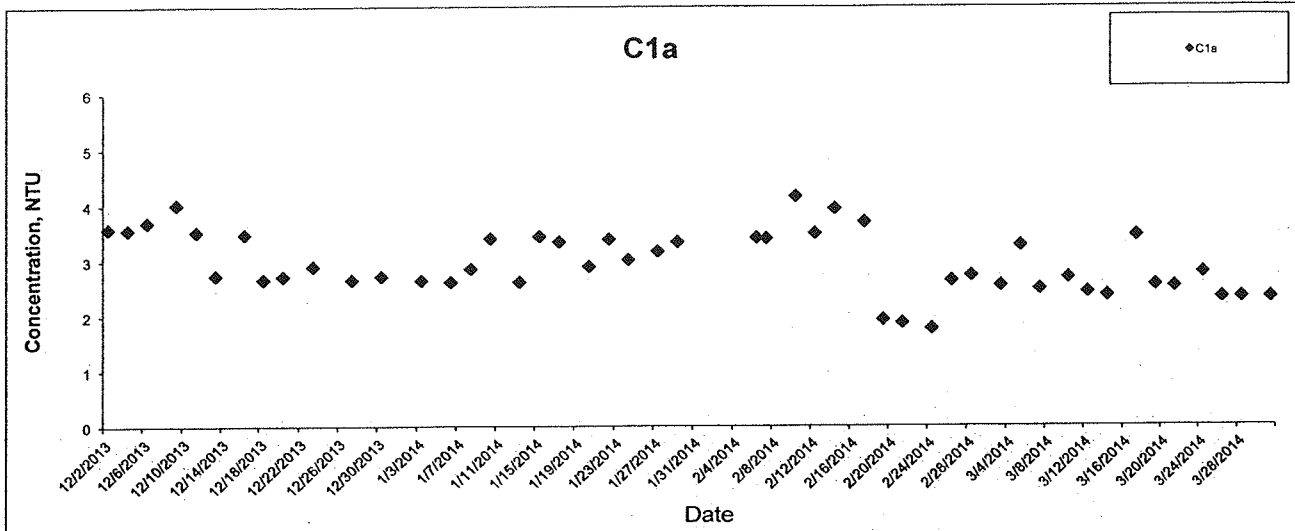



### Turbidity at Mid-Flood Tide

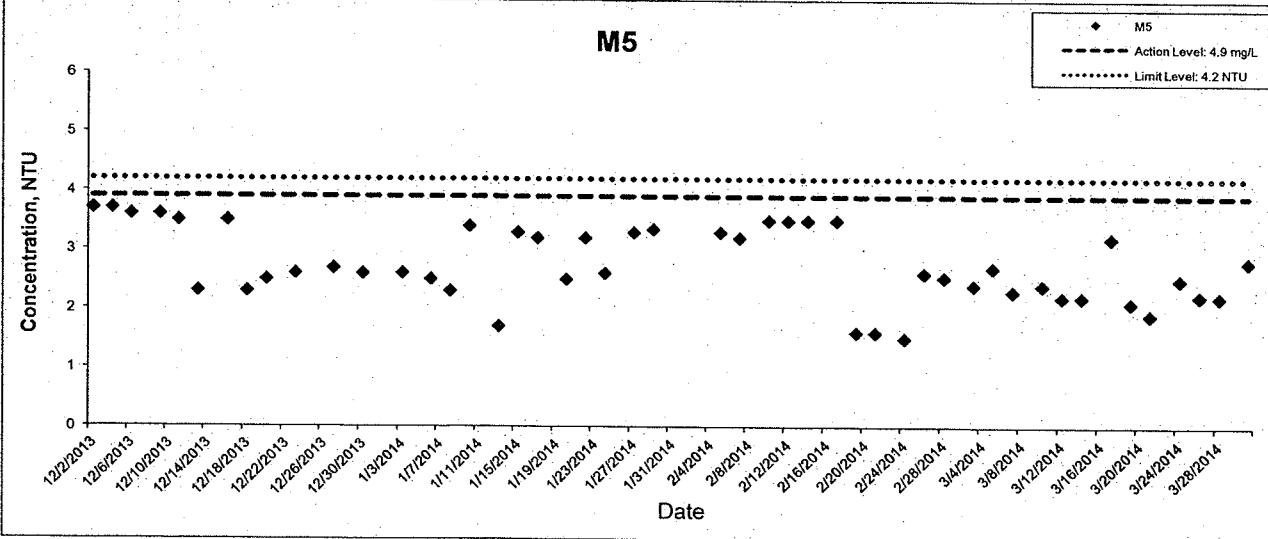
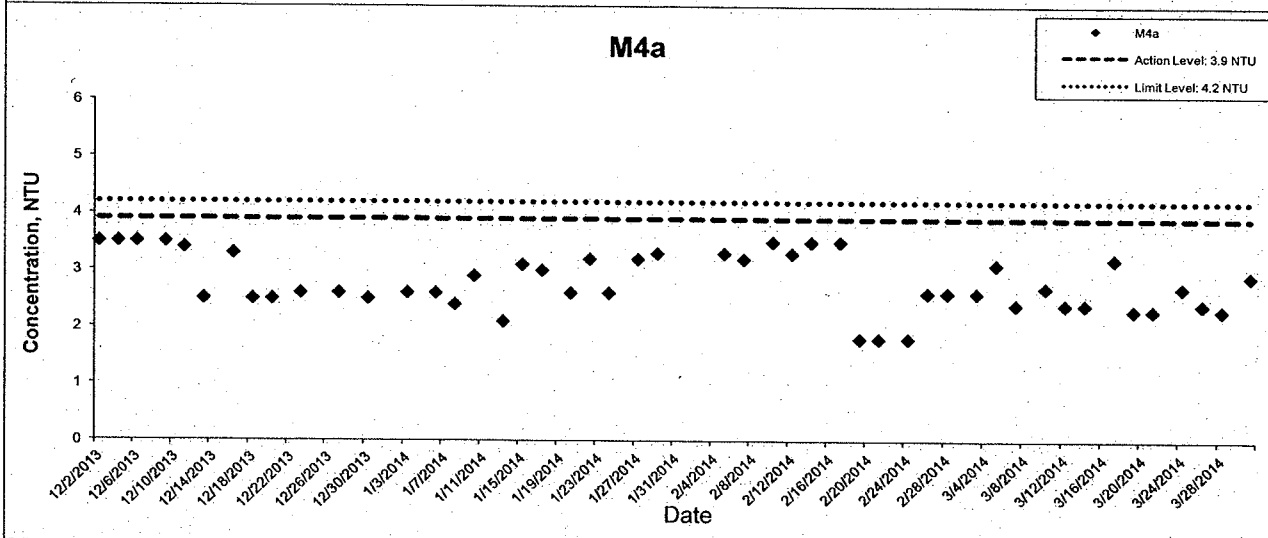
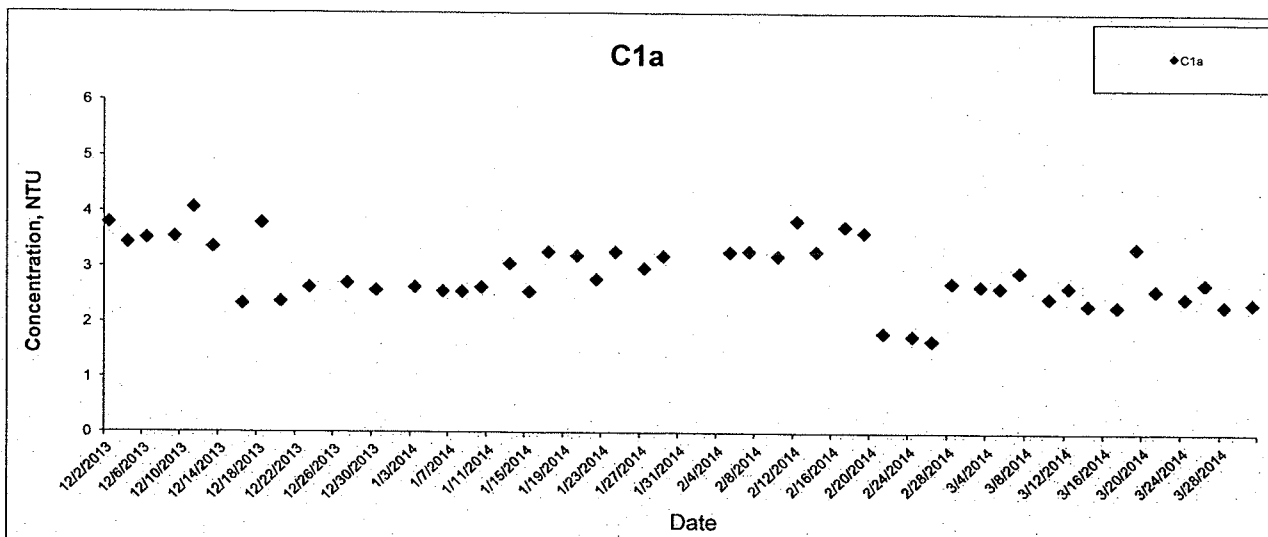


HONG KONG - ZHUHAI - MACAO BRIDGE  
 HONG KONG BOUNDARY CROSSING FACILITIES  
 - RECLAMATION WORKS


Graphical Presentation of Impact Water Quality  
 Monitoring Results



## Suspended Solids at Mid-Ebb Tide

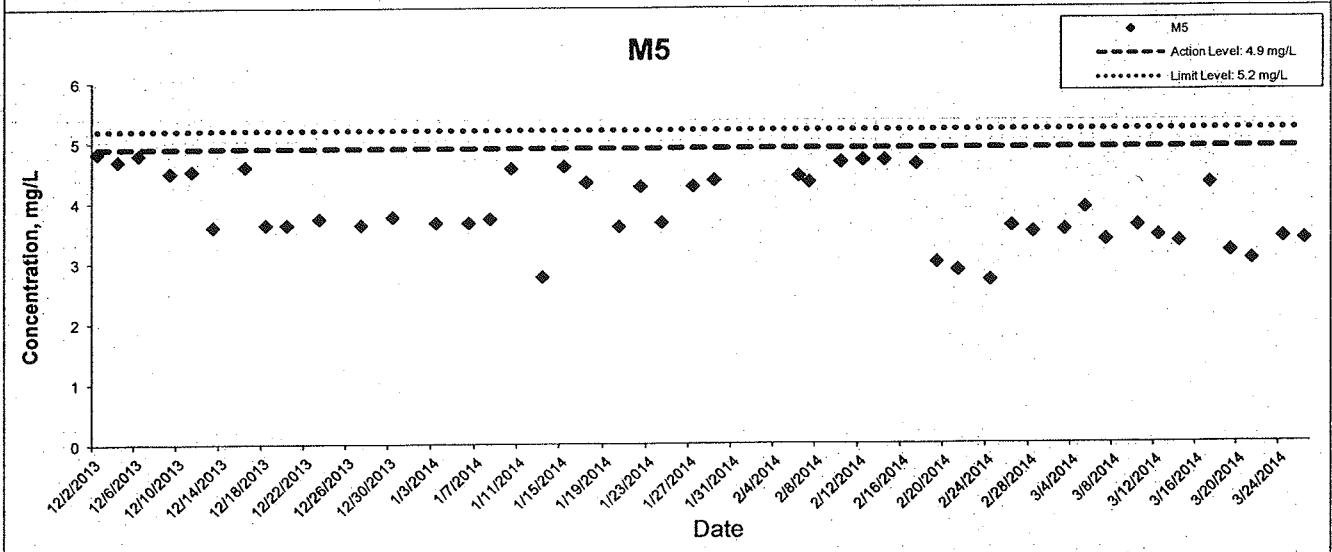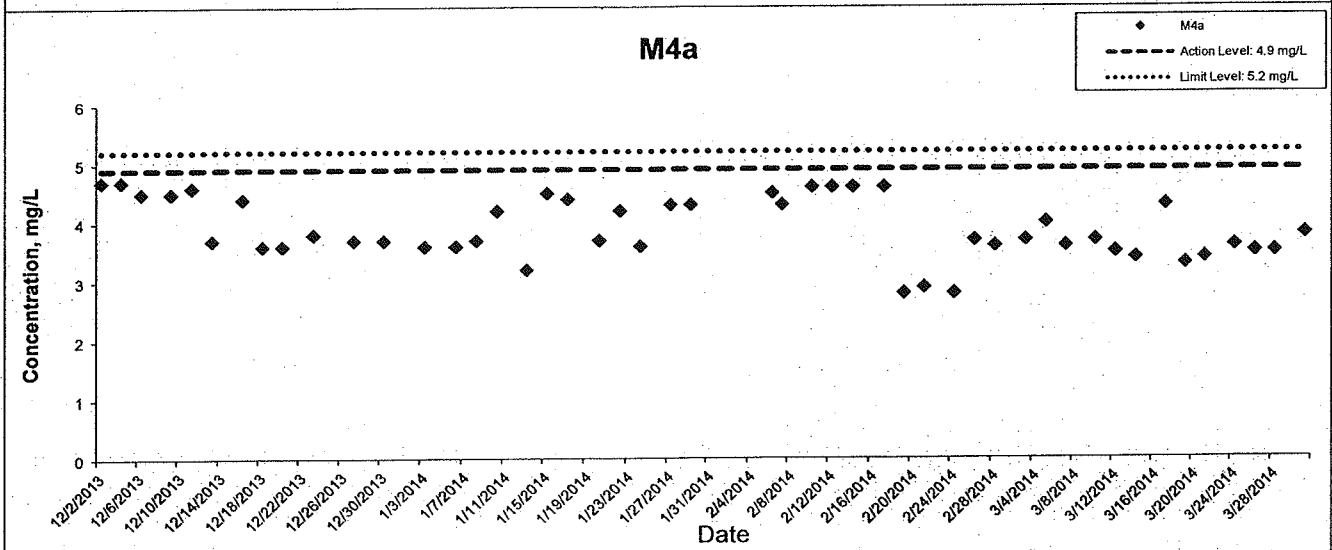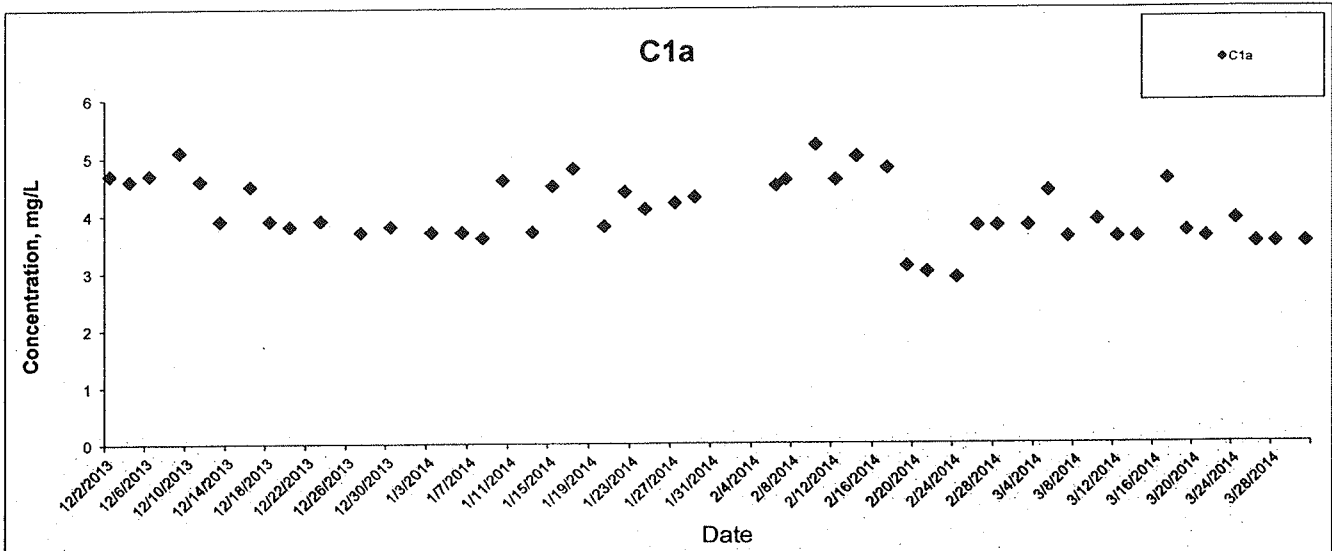

## Suspended Solids at Mid-Flood Tide

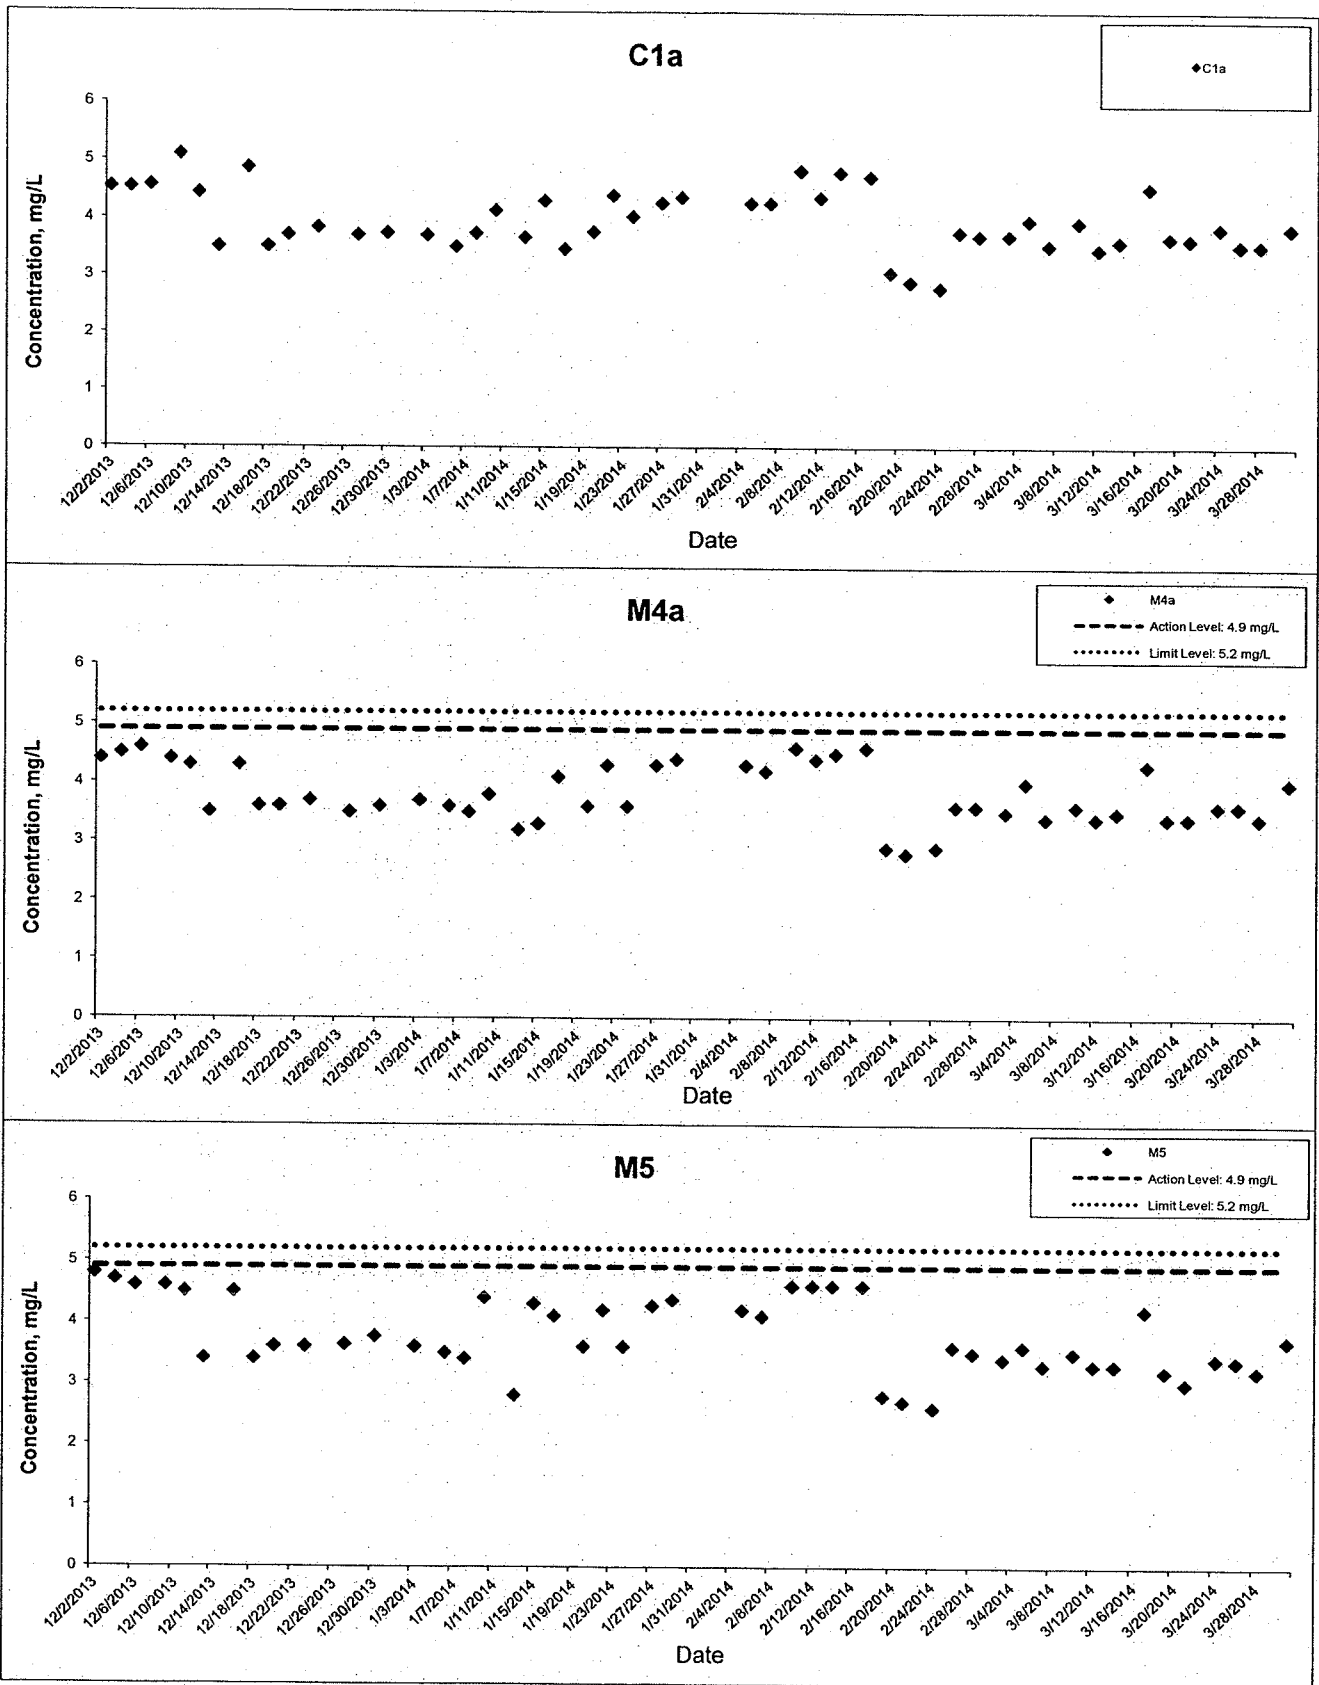

This document was prepared for the use of the Client. It is not to be used for any other purpose without the written consent of AECOM. AECOM shall not be responsible for any errors or omissions in this document, and shall not be liable for any damages, including consequential damages, arising from the use of this document. AECOM shall not be responsible for any actions taken by the Client or any third party based on the information contained in this document.

**APPENDIX D  
QA/QC REPORT**

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/12/2014	96.3	FC1a-S1	0.00	EC1a-S2	95.7
	102.0	EC1a-M1	10.53**	EWM5-B2	95.9

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/14/2014	97.2	FC1a-S1	10.53**	EC1a-S2	102.0
	102.0	EC1a-M1	0.00	EWM5-B2	94.1

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/17/2014	107.4	FC1a-S1	0.00	EC1a-S2	102.0
	103.3	EC1a-M1	8.00	EWM5-B2	100.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/19/2014	94.9	FC1a-S1	10.53**	EC1a-S2	103.8
	92.8	EC1a-M1	0.00	EWM5-B2	104.3

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/21/2014	103.2	FC1a-S1	0.00	EC1a-S2	97.9
	99.8	EC1a-M1	9.52	EWM5-B2	96.1

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/24/2014	98.6	FC1a-S1	10.53**	EC1a-S2	94.0
	105.9	EC1a-M1	0.00	EWM5-B2	100.0

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/26/2014	103.6	FC1a-S1	0.00	EC1a-S2	96.2
	105.3	EC1a-M1	10.53**	EWM5-B2	104.2

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/28/2014	92.9	FC1a-S1	0.00	EC1a-S2	94.0
	98.8	EC1a-M1	10.53**	EWM5-B2	107.7

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
03/31/2014	97.5	FC1a-S1	0.00	EC1a-S2	100.0
	92.5	EC1a-M1	10.53**	EWM5-B2	102.1

Note: (\*) % Recovery of QC sample should be between 80% to 120%.  
 (#) % Error of Sample Duplicate should be between 0% to 10%.  
 (@) % Recovery of Sample Spike should be between 80% to 120%.  
 (\*\*) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.