

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

HKPFH Joint Venture

**Contract No.: CV/2013/06
Handling of Surplus Public Fill
(2014-2016)**

TSEUNG KWAN O AREA 137 FILL BANK

MONTHLY EM&A REPORT NO.27


(MARCH 2016)

Prepared by:



LAW, Sau Yee
Senior Environmental Officer

Checked by:



LAU, Chi Leung
Environmental Team Leader

Issue Date: 11 April 2016

Report No.: ENA61279

Ref.: CEDPFRSFEM01_0_0622L.16

13 April 2016

By E-mail and Fax No.: 2695 3944

ETS-Testconsult Limited
8/F, Block B
Veristrong Industrial Centre
34-36 Au Pui Wan Street
Fo Tan, Hong Kong

Attention: Mr. C L Lau

Dear Mr. Lau,


**Re: Contract No. CV/2013/06
Handling of Surplus Public Fill (2014 – 2016)
Monthly EM&A Report (No. 27) for March 2016 for the Tseung Kwan O Area 137
Fill Bank**

Reference is made to your submission of the draft Monthly EM&A Report for March 2016 for the TKO Area 137 Fill Bank received by E-mail on 12 April 2016 and the subsequent revision on 13 April 2016.

We are pleased to inform you that we have no further comment on the captioned report.

Thank you very much for your attention and please do not hesitate to contact our Jason Lai or the undersigned should you have any queries.

Yours sincerely,



Tony Cheng
Independent Environmental Checker

c.c.	CEDD	Attn: Mr. Terry Chock / Mr. Simon Leung	Fax No.: 2714 0113
	HKPFHJV	Attn: Mr. Eric Wan	Fax No.: 2744 6937

Q:\Projects\CEDPFRSFEM01\02 Project Management\02 Corr\CEDPFRSFEM01_0_0622L.16.doc




TABLE OF CONTENTS		Page
EXECUTIVE SUMMARY		
1.0	INTRODUCTION	1
2.0	PROJECT INFORMATION	
	2.1 Scope of the Project	1
	2.2 Site Description	1
	2.3 Work Programme	2
	2.4 Project Organization and Management Structure	2
	2.5 Contact Details of Key Personnel	2
3.0	WORK PROGRESS IN THIS REPORTING MONTH	2
4.0	AIR QUALITY MONITORING	
	4.1 Monitoring Requirement	2
	4.2 Monitoring Equipment	2
	4.3 Monitoring Parameters, Frequency and Duration	2
	4.4 Monitoring Locations and Schedule	3
	4.5 Monitoring Methodology	3
	4.6 Action and Limit levels	4
	4.7 Event-Action Plans	4
	4.8 Results and Observation	4
5.0	NOISE MONITORING	
	5.1 Monitoring Requirements	4
	5.2 Monitoring Equipment	4 – 5
	5.3 Monitoring Parameters, Duration and Frequency	5
	5.4 Monitoring Locations and Month	5
	5.5 Monitoring Procedures and Calibration Details	5
	5.6 Action and Limit levels	5
	5.7 Event-Action Plans	6
	5.8 Results and Observation	6
6.0	MARINE WATER QUALITY MONITORING	
	6.1 Monitoring Requirements	6
	6.2 Monitoring Locations	6
	6.3 Monitoring Parameters	6
	6.4 Monitoring Frequency	7
	6.5 Monitoring Methodology and Equipment Used	7 - 8
	6.6 Action and Limit Level	9
	6.7 Event and Action Plan	9
	6.8 Monitoring Duration and Month in this reporting month	9
	6.9 Marine Water Monitoring Results	9
7.0	ENVIRONMENTAL AUDIT	
	7.1 Weekly ET Site Inspections	10
	7.2 Review of Environmental Monitoring Procedures	10
	7.3 Assessment of Environmental Monitoring Results	10
	7.4 Advice on the Solid and Liquid Waste Management Status	11
8.0	STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING	11
9.0	ENVIRONMENTAL NON-CONFORMANCE	
	9.1 Summary of air quality, noise and marine water quality	12
	9.2 Summary of Environmental Complaints	12
	9.3 Summary of Notification of Summons and Prosecution	12
10.0	IMPLEMENTATION STATUS	
	10.1 Implementation Status of Environmental Mitigation Measures	12
	10.2 Implementation Status of Event and Action Plan	12
	10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling	12
11.0	CONCLUSION AND RECOMMENDATIONS	12 – 13
12.0	FUTURE KEY ISSUE	
	12.1 Work Programme for the Coming Month	14
	12.2 Key Issues for the Coming Month	14 – 15
	12.3 Monitoring Schedule for the Coming Month	15



APPENDIX I

A	Organization Chart and Lines of Communication
B1	Calibration Certificates for Impact Air Quality Monitoring Equipment
B2	Impact Air Quality Monitoring Results
B3	Graphical Plots of Impact Air Quality Monitoring Data
C1	Calibration Certificates for Impact Noise Monitoring Equipment
C2	Impact Noise Monitoring Results
C3	Graphical Plots of Impact Noise Monitoring Data
D1	Calibration Certificates for Impact Marine Water Quality Monitoring Equipment
D2	Impact Marine Water Quality Monitoring Results
D3	Graphical Plots of Impact Marine Water Quality Monitoring Data
E	Weather Condition
F	Event-Action Plans
G	Work Programme
H	Weekly ET's Site Inspection Record
I	Implementation Schedule of Mitigation Measures
J	Site General Layout Plan
K	Monitoring Schedule for the Coming Month
L	Complaint Log

APPENDIX I

FIGURES

Figure 1	Locations of Water Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank
Figure 2	Location of Noise Quality Monitoring Station – Tseung Kwan O Area 137 Fill Bank
Figure 3	Locations of Air Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank

APPENDIX II

Marine Water Quality Monitoring Report for Contract No. HY/2010/02 Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing Facilities – Reclamation Works

TABLES

2.1	Contact Details of Key Personnel
4.1	Air Quality Monitoring Equipment
4.2	Monitoring parameters, duration and frequency of air quality monitoring
4.3	Air Quality Monitoring Locations
4.4	Action and Limit levels for 24-hr TSP and 1-hr TSP
5.1	Noise Monitoring Equipment
5.2	Duration, Frequency and Parameters of noise monitoring
5.3	Noise Monitoring Location
5.4	Action and Limit levels for noise monitoring
6.1	Locations of Marine Water Monitoring Stations
6.2	Marine Water Quality Monitoring Parameters
6.3	Monitoring frequency of the marine water
6.4	Summary of testing procedures
6.5	Details of Marine Water Quality Monitoring Equipment (In-site measurement)
6.6	Water Quality Action and Limit Levels
6.7	Time Schedule of Impact Marine Water Quality Monitoring
6.8	Summary of Impact Marine Water Quality Exceedances in this reporting month
7.1	Key Findings of Weekly ET Site Audits in this reporting month
7.2	Actual amounts of Waste generated in this reporting month
8.1	Summary of environmental licensing and permit status
10.1	Summary of Environmental Complaints and Prosecutions



EXECUTIVE SUMMARY

This monthly Environmental Monitoring and Audit (EM&A) report No.27 was prepared by ETS-Testconsult Ltd (ET) for the “Contract No: CV/2013/06 – Handling of Surplus Public Fill (2014-2016) – Tseung Kwan O (TKO) Area 137 Fill Bank” (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at TKO Area 137 in March 2016.

Site Activities

As informed by the Contractor, the site activities in this reporting month were as below:

1. Operation of the TKO137 Fill Bank.
2. Transferring public fill to vessel and delivering to Taishan and other parties
3. Remedial works for existing trees

Environmental Monitoring Progress

The summary of the monitoring activities in this monitoring month is listed below:

- Noise Monitoring (Day-time): 1 Occasion at 1 designated location
- 24-hour TSP Monitoring: 5 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 16 Occasions at 2 designated locations
- Marine Water Quality Monitoring: 11 Occasions at 2 designated locations
- Weekly-site inspection: 5 Occasions

Noise Monitoring

No exceedance of Action and Limit levels for noise monitoring was recorded in the reporting month.

Air Monitoring

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting month.

Marine Water Quality Monitoring

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded in this reporting month.

Weekly Site Inspections

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting month. The major findings observed during site inspections are presented in the Section 7.0.

Environmental Complaints, Notification of summons and successful prosecutions

No complaint, notification of summons or successful prosecutions with respect to environmental issues was received in this month.

Future Key Issues

Based on site inspections and forecast of engineering works in coming month, key issues to be considered are as follows:

- Noise and air quality impact due to site works;
- Maintain wheel washing facilities properly;
- Maintain all drainage and desilting facilities properly;
- Use and maintain silt curtain properly;
- Clean up the fill material on concrete pavement along the BHA frequently;
- Sufficient drip trays for all oil drums / chemical containers;
- Implement all necessary preventive measures to avoid oil leakage. In the event an oil leakage happens, the Contractor should properly remove the leaked oil and handle the contaminated soil and all materials using for this cleaning works as chemical waste;
- Maintain good site practice and waste management to minimize environmental impacts at the site; and
- Follow-up improvements on waste management issues.



1.0 INTRODUCTION

HKPFH Joint Venture (HKPFH-JV) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the “Contract No: CV/2013/06 – Handling of Surplus Public Fill (2014-2016) – Tseung Kwan O (TKO) Area 137 Fill Bank” (The Project).

In accordance with the Environmental Permit (No.: EP-134/2002/K) (the EP), an EM&A programme should be implemented in accordance with the procedures and requirements in the EM&A Manual of the approved EIA report (Registration No. AEIAR-060/2002). The EM&A programme for this study as stated in Section 2.3.1 of the EM&A Manual covers the following environmental aspects during the establishment, operation and removal phases of the Fill Bank at Tseung Kwan O Area 137:

- *Fugitive Dust;*
- *Noise generation from onsite activities;*
- *Water Quality; and*
- *Landscape and Visual.*

The EM&A programme requires environmental monitoring for air quality, noise and water quality and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- *All monitoring parameters;*
- *Monitoring schedules for the reporting month and forthcoming months;*
- *Action and Limit levels for all environmental parameters;*
- *Event/Action Plans;*
- *Environmental mitigation measures, as recommended in the Project EIA study final report; and*
- *Environmental requirements in contract documents.*

Baseline monitoring was completed in August and September 2002 by MaterialLab. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 in March 2016.

2.0 PROJECT INFORMATION

2.1 Scope of the Project

The scale and scope of the Project as stated in the EP include:

- Site clearance;
- Construction of a temporary storm water system;
- Stockpiling of 6 million m³ of public fill;
- Setting up two barging points: one at the TKO Basin and one at the Construction and Demolition Material Sorting Facility (C&DMSF) for transporting the stockpiled public fill by barges;
- Setting up a temporary barging point at the existing Explosive Off-loading Barging Point located in the south-eastern part of Area 137 for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge;
- Construction and operation of a Construction and Demolition Material Sorting Facility (C&DMSF);
- Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin; and
- Remove the temporary fill bank.

2.2 Site Description

TKO Area 137 Fill Bank is located at the southern end of Wan Po Road. In the vicinity of the site are other industrial uses such as SENT landfill, TKO Industrial Estate, etc. Both Island Resort and Fullview Garden are also situated at more than 1.8km from the site. Other existing ASRs and NSRs, including resident developments and schools, are located at a further distance away from TKO Area 137.



2.3 Work Programme

Details of work programme are shown in Appendix I G.

2.4 Project Organization and Management Structure

The project organization chart is shown in Appendix I A.

2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Simon Leung, Terry Chock, Patrick Ng, James Sze, Phoebe Tang	Engineer's Representative	2762 5555	2714 0113
IEC (Ramboll Environ)	Tony Cheng	IEC	3465 2888	3465 2899
Contractor (HKPFH-JV)	K W Li	Project Manager	9750 6438	2744 6937
ET (ETL)	C. L. Lau	ET Leader	2946 7791	2695 3944

3.0 WORK PROGRESS IN THIS REPORTING MONTH

As informed by the Contractor, the activities in the reporting month include:

1. Operation of the TKO137 Fill Bank.
2. Transferring public fill to vessel and delivering to Taishan and other parties
3. Remedial works for existing trees

4.0 AIR QUALITY MONITORING

4.1 Monitoring Requirement

TSP levels were monitored in the reporting month in accordance with the EM&A Manual. Table 4.4 shows the Action and Limit Levels for the environmental monitoring works.

4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificates for the HVS and calibrator are attached in Appendix I B1.

Table 4.1 Air Quality Monitoring Equipment

Equipment	Model and Make
HVS	Greasby GMWS2310
Calibrator	Tisch TE-5025A

4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequency of air quality monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr	Once every six days
1-hr TSP	1 hr	Three times per day every six days



4.4 Monitoring Locations

Table 4.3 tabulates the air quality monitoring locations of this project.

Table 4.3 Air quality monitoring locations

<i>Monitoring station</i>	<i>Location</i>
<i>TKO-A1</i>	<i>Site Egress</i>
<i>TKO-A2a</i>	<i>CREO</i>

4.5 Monitoring Methodology

Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)

Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

Installation

The installation of HVS refers to the requirement stated in EM&A Manual.

Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 0.6m³/min and 1.7m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The flow rate was indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (Whatman G653) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling month of 1 hour or 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recorded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of 25°C ± 3°C and the relative humidity (RH) <50% ±5%.
- All measurement procedures in Section 2.3 of the EM&A Manual were followed during the reporting month.

Maintenance & Calibration

- HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

Wind Data Monitoring

Wind data (wind speed and wind direction) were directly extracted from Tseung Kwan O Station of Hong Kong Observatory. All wind data during this reporting month are shown in Appendix I E.



4.6 Action and Limit Levels

Table 4.4 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Table 4.4 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring Location	24-hr TSP ($\mu\text{g}/\text{m}^3$)		1-hr TSP ($\mu\text{g}/\text{m}^3$)	
	Action Level	Limit Level	Action Level	Limit Level
TKO-A1	210	260	376	500
TKO-A2a *	210	260	376	500

Remark (*): Since dust monitoring stations TKO-A2 and TKO-A2a are located close to the major dust emission sources and also close to the same sensitive receptor and no significant difference between them on the prevailing meteorological conditions, the baseline data from TKO-A2 (August and September 2002 by Materialab) can also be valid in the case of TKO-A2a.

4.7 Event-Action Plans

Please refer to Appendix I F for details.

4.8 Results and Observation

4.8.1 1-hour and 24-hour TSP Monitoring results

Monitoring data of both 1-hour and 24-hour TSP monitoring carried out in this reporting month are summarized in Appendix I B2. Graphical presentation of 1-hour and 24-hour TSP monitoring results for the reporting month is shown in Appendix I B3. Wind data included wind speed and wind direction was extracted from Tseung Kwan O Station of Hong Kong Observatory during this reporting month and is presented in Appendix I E.

No exceedance of Action and Limit Level of 1-hr TSP and 24-hour TSP monitoring results was recorded during the reporting month.

4.8.2 Observation

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of the mist spraying systems at the CEDD Combined Reception Office and the site egress area, wheel washing facilities, road dampening by water bowsers and automatic water sprinklers on the main haul roads. Furthermore, hydroseeded slopes on the stockpiling areas was maintained properly in order to prevent dust generation from wind erosion of the exposed surfaces. Other dust sources near TKO Area 137 also included operation of the temporary CWSF and dumping activities at the SENT Landfill.

5.0 Noise Monitoring

5.1 Monitoring Requirements

Noise monitoring was conducted at 1 monitoring station as specified in the approved EM&A Monitoring Proposal for good site practice. The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting month are presented in this section.

5.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level (L_{eq}) and percentile sound pressure level (L_x). It complies with International Electro Technical Commission Publications 651:1979 (Type1) and 804:1985 (Type1), and speed in m/s was used to monitor the wind speed.

Table 5.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix I C1.



Table 5.1 Noise Monitoring Equipment

Equipment	Model
Sound Level Meter	Rion NL-31 / Rion NL-52
Sound Level Calibrator	Rion NC-73 / Castle GA607

5.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 5.2.

Table 5.2 Duration, Frequencies and Parameters of Noise Monitoring

Time month	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	L_{eq} , L_{10} , L_{90}	Once per month

5.4 Monitoring Locations

One Noise monitoring was conducted at the noise monitoring location, TKO-N1 as shown in Figure 2 during the reporting month. Table 5.3 describes the location of the monitoring station.

Table 5.3 Noise Monitoring Location

Monitoring station	Location	Type of Measurement
TKO-N1	Outside site Egress along Wan Po Road	Free Field

5.5 Monitoring Procedures and Calibration Details

Operation/Analysis Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - Frequency weighting: A
 - Time weighting : Fast
 - Time measurement : 30 mins
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring month, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

5.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 5.4.

Table 5.4 Action and Limit Levels for noise monitoring

Time Month	Time Month	Action	Limit
Normal hours	0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)



5.7 Event-Action Plans

Please refer to the Appendix I F for details.

5.8 Results and Observation

5.8.1 Results

Only Day-time noise monitoring was carried out at monitoring station TKO-N1 in this reporting month. The detail of the noise monitoring is provided in Appendix I C2. Graphical presentation of the monitoring result for the reporting month is shown in Appendix I C3.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedances were recorded. Besides, no exceedances in Limit Level were recorded according to the result from Day-time monitoring.

5.8.2 Observation

The major noise source during the monitoring event was the dump truck traffic. Operation of the Fill Bank was from 08:00 to 21:00 from Monday to Sunday in the reporting month. Whereas the operation hours for barge activities in the TKO Basin was from 08:00 to 21:00. The monitoring result complied with the noise limit of 75dB(A).

6.0 MARINE WATER QUALITY MONITORING

6.1 Monitoring Requirements

In accordance with the EM&A Manual, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at Control Station, C1 and Monitoring Station, M4.

6.2 Monitoring Locations

For the Reclamation Project, there were 4 Designated Monitoring Stations and 2 Designated Control Stations specified in the EM&A Manual. Upon the completion of the monitoring programme under Stage 2 reclamation works, the ET started monitoring events at the impact station M4 and the control station C1 from 18 May 2004 onwards. Figure 1 shows the location of the marine water quality monitoring stations. Table 6.1 describes the locations of the monitoring stations in the reporting month.

Table 6.1 Locations of Marine Water Monitoring Stations


Station Description	Code	HK Metric Grid E	HK Metric Grid N
Control Station (Ebb tide)	TKO-C1	844 740.208	815 371.502
Monitoring Station, Tung Lung Chau Fish Culture Zone	TKO-M4	847 741.029	812 977.878

6.3 Monitoring Parameters

Monitoring of the marine water quality parameters are listed in Table 6.2.

Table 6.2 Marine Water Quality Monitoring Parameters

In-situ measurement	Laboratory analysis
Depth (m)	Suspended solids (mg/L)
Temperature (°C)	
Dissolved Oxygen (mg/L and % saturation)	
Turbidity (NTU)	
Salinity (ppt)	



6.4 Monitoring Frequency

The monitoring frequency of the marine water monitoring is summarized in Table 6.3.

Table 6.3 Monitoring frequency of the marine water

Parameter	Frequency	No. of Location	No. of Depths
Temperature	3 days/week, 2 tides/day	2 (TKO-C1 and TKO-M4)	3 (Surface, mid-depth & bottom)
Salinity			
DO			
Turbidity			
Suspended solids			

6.5 Monitoring Methodology and Equipment Used

For Location of the monitoring stations

Global Positioning System (GPS)

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

For Water Depth measurement

Echo Sounder

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.

Dissolved Oxygen, Salinity and Temperature Measuring Equipment

A portable, weatherproof dissolved oxygen & salinity measuring instrument, which complete with cable, sensor and DC power source (e.g. YSI 85 or equivalent) was used for measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200 % saturation;
- a salinity in range 0-40 ppt; and
- a temperature of 0-45 degree Celsius

A membrane electrode with automatic temperature compensation complete with a cable was installed.

Turbidity Measurement Instrument

A portable and weatherproof turbidity meter (HACH model 2100Q) was used during impact monitoring. It has a photoelectric sensor capable of measuring turbidity between 0-1000 NTU. Response of the sensor was checked with certified standard Turbidity solutions before the start of measurement.

For Water Sampling and Sample Analysis

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. If the water depth is less than 6 m, the mid-depth station shall be omitted and if the water depth is below 3 m, only the mid depth station shall be monitored.

Water Sampler

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.

Water Container

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labelled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 6.4.

Table 6.4 Summary of testing procedures

Laboratory Analysis	Testing Procedure	Detection Limit
Total suspended solids	In house method based on APHA 19 th ed 2540D	1.0 mg/L

In-situ measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before the start of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO, DOS and Salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required.

Table 6.5 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix I D1.

Table 6.5 Details of Marine Water Quality Monitoring Equipment (In-site measurement)

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	Garmin eTrex 10	-----	-----	ET/EW/005/04
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI 85	26/01/16	25/04/16	ET/EW/008/001 *
Turbidity	HACH Model 2100Q Turbid Meter	30/12/15 29/03/16	29/03/16 28/06/16	ET/0505/012 *
Water Depth	Speedtech SM-5	-----	-----	ET/EW/002/08

Remark:(*) indicates the instrument should be calibrated on use.

6.6 Action and Limit Level

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.



Table 6.6 Water Quality Action and Limit Levels

Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface & Middle</u> <5.45 mg/L (5%-ile of baseline data) <u>Bottom</u> <4.72 mg/L (5%-ile of baseline data)	<u>Surface & Middle</u> <5.10 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth-averaged)	>6.74 mg/L (95%-ile of baseline data) or >120% of the upstream control station's SS at the same tide on the same day	>7.67 mg/L (99%-ile of baseline data) or >130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth-averaged)	>4.28 NTU (95%-ile of baseline data) or >120% of the upstream control station's turbidity at the same tide on the same day	>4.58 NTU (99%-ile of baseline data) or >130% of the upstream control station's turbidity at the same tide on the same day

6.7 Event and Action Plan

Please refer to the Appendix I F for details.

6.8 Monitoring Duration and Month in this reporting month

Below is the time schedule for the marine water quality monitoring events that were conducted in this reporting month:

Table 6.7 Time Schedule of Impact Marine Water Quality Monitoring

March 2016						
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1	2	3	4	5
			▼		▼	
6	7	8	9	10	11	12
	▼		▼		▼	
13	14	15	16	17	18	19
	▼		▼		▼	
20	21	22	23	24	25	26
	▼		▼			
27	28	29	30	31		
			▼			

Remarks: (▼) = Marine water quality monitoring carried out by ET.

The daily marine water quality monitoring duration are detailed in Appendix I D2.

6.9 Marine Water Quality Monitoring Results

The impact water quality measurement results are detailed in Appendix I D2. Appendix I D3 presents the water quality monitoring data and graphical presentations of monitoring results respectively. The summary of marine water quality exceedances is shown in Table 6.8.

Table 6.8 Summary of Impact Marine Water Quality Exceedances in this reporting month

Station	Exceedance Level	DO		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
TKO-C1	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0
TKO-M4	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0

According to the summary of marine water monitoring results, no exceedance of Action and limit levels was recorded for this reporting month.



7.0 ENVIRONMENTAL AUDIT

7.1 Weekly ET Site Inspections

Weekly ET site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting month, five weekly site inspections were conducted (02, 09, 16, 22 and 30 March 2016). Table 7.1 presents the key findings of weekly ET site inspection in this reporting month.

Table 7.1 Key Findings of Weekly ET Site Audits in this reporting month

Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor during the ET weekly site audit	Rectification Status by ET
02 March 2016	Debris of dead leaves were accumulated inside the u-channel near site entrance. (New item)	To clear the accumulated leaves in order to avoid any blockage.	---	Follow-up
09 March 2016	Debris of dead leaves were accumulated inside the u-channel near site entrance. (Previous item)	To clear the accumulated leaves in order to avoid any blockage.	---	Follow-up
	Stagnant water was observed on the ground near work shop. (New item)	To remove the stagnant water as soon as possible.	---	Follow-up
16 March 2016	Debris of dead leaves were accumulated inside the u-channel near site entrance. (Previous item)	To clear the accumulated leaves in order to avoid any blockage.	Debris of dead leaves accumulated inside the u-channel near site entrance were cleared.	Closed
	Stagnant water was observed on the ground near work shop. (Previous item)	To remove the stagnant water as soon as possible.	Stagnant water observed on the ground near work shop was cleared.	Closed
	Mud and silt were noted accumulated inside the u-channel near wheel washing bay. (New item)	To clear the accumulated mud and silt in order to avoid any blockage.	---	Follow-up
22 March 2016	Mud and silt were noted accumulated inside the u-channel near wheel washing bay. (Previous item)	To clear the accumulated mud and silt in order to avoid any blockage.	Mud and silt accumulated inside the u-channel near wheel washing bay were cleared.	Closed
	Mud and silt were noted accumulated inside CP5. (New item)	To clear the accumulated mud and silt in order to avoid any blockage.	---	Follow-up
30 March 2016	Mud and silt were noted accumulated inside CP5. (Previous item)	To clear the accumulated mud and silt in order to avoid any blockage.	Mud and silt accumulated inside the CP5 were cleared.	Closed
	Mud was found accumulated along the barge handling area (BHA). (New item)	To clear the accumulated mud properly and provide the barrier to prevent fill material dropping to the sea.	---	Follow-up

7.2 Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. The observations for the monitoring works were recorded and summarized as follows:

Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.



Noise Monitoring

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.

Water Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.

7.3 Assessment of Environmental Monitoring Results

All monitoring results were audited against the Action and Limit levels and any exceedance would be validated.

No exceedance was recorded in water quality, air quality and noise monitoring in this month.

The monitoring results in this reporting month were comparable with those of baseline month. Detailed discussions were given in Section 4, 5 and 6 of this Report.

7.4 Advice on the Solid and Liquid Waste Management Status

The Contractor usually disposed of non-inert waste, including general refuse and materials segregated from the existing stockpiles, to SENT landfill. Table 7.2 summarizes data on offsite waste disposal in this reporting month.

Table 7.2 Actual amounts of Waste generated in this reporting month

Waste Type	Actual Amount	Disposal Locations
Public Fill (m ³)	0	TKO 137 Fill Bank
C&D Waste (kg)	0	SENT Landfill / Refuse Collection Point
Chemical Waste (kg/L)	400	Collected by licensed collector

The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.

Concrete bunding has erected outside the CEDD combined reception office and near the automatic wheel washing facilities for storing generator sets and oil drums. The drain outlet of all the bunded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal were properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank, DP3 and DP4 and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.

All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

8.0 Status of Environmental Licensing and Permitting

All permits/licenses valid in this reporting month are summarized in Table 8.1.

Table 8.1 Summary of environmental licensing and permit status



Description	Permit No.	Valid Month		Section
		From	To	
Amended Environmental Permit	EP-134/2002/K	04/02/13	----	<ul style="list-style-type: none"> ▪ Site clearance ▪ Construction of a temporary storm water system ▪ Stockpiling of 6 million m3 of public fill ▪ Setting up two barging points for transporting the stockpiled public fill by barges ▪ Setting up a temporary barging point at the existing Explosive Off-loading Barging Point for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge ▪ Construction of operation of a construction and Demolition Material Sorting Facility (C&DMSF) ▪ Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin ▪ Remove the temporary fill bank
Effluent Discharge License	WT000188 97-2014	11/07/14	31/07/19	<ul style="list-style-type: none"> ▪ Wastewater arising from the wheel washing bay of the premises, Sedimentation Tank & Desilting Tank
Marine Dumping Permit	EP/MD/16-150	01/01/16	31/03/16	<ul style="list-style-type: none"> ▪ Approval for dumping 3,800,000 tons (approximately equal to 2,111,111 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan
Chemical Waste Producer	5213-839-H3552-01	21/01/14	----	<ul style="list-style-type: none"> ▪ Spent Lubricating Oil and Spent Battery
Billing Account for Waste Disposal	7018998	---	---	<ul style="list-style-type: none"> ▪ ---

9.0 ENVIRONMENTAL NON-CONFORMANCE

9.1 Summary of air quality, noise and marine water quality

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

9.2 Summary of Environmental Complaints

No complaint was received in this reporting month.

9.3 Summary of Notification of Summons and successful Prosecution

There was no notification of summons and successful prosecution respect to environmental issues registered in this reporting month.

10.0 IMPLEMENTATION STATUS

10.1 Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix I I. Most of the necessary mitigation measures were implemented properly. Any deficiencies were noted in the remarks of the schedule.



10.2 Implementation Status of Event and Action Plan

Since no exceedance of Action and Limit level of air, noise and marine water monitoring results was recorded for this reporting month, no further action was required.

10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

No complaint, notification of summon and successful prosecution was received in this month.

A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 10.1 and further details of the complaint could be found in the Complaint Log (Appendix I L).

Table 10.1 Summary of Environmental Complaints and Prosecutions

Complaints logged		Summons served		Successful prosecution received	
March 2016	Cumulative	March 2016	Cumulative	March 2016	Cumulative
0	1	0	0	0	0

11.0 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

Impact monitoring of air quality, noise and water quality were carried out at designated locations in accordance with the EM&A Manual in this reporting month.

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

No complaints, prosecutions and notifications of summons were received in this reporting month.

According to the ET weekly site inspections carried out in this reporting month, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

Recommendations

According to the environmental site inspections performed in the reporting month, the following recommendations were provided:

Air Quality

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowser;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the site activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

Noise

- Conduct noisy activities at a farther location from the NSRs.



Water Quality

- Maintain the drainage system, including the trapezoidal channels, permanent desilting chambers, regularly;
- Operate and maintain the silt curtains regularly;
- Operate the cleaning vessel within the TKO Basin regularly;
- Clean up the fill material on the concrete pavement at BHA frequently; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

Landscape and Visual

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeded slopes in accordance with the Landscape Plan.

Chemical and Waste Management

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain mesh screen on top of the additional drainage to avoid improper dumping of rubbish;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.

12.0 FUTURE KEY ISSUES

12.1 Work Programme for the Coming Month

As informed by the Contractor, the activities to be conducted by them in the next month included:

1. Operation of the TKO137 Fill Bank.
2. Transferring public fill to vessel and delivering to Taishan and other parties.
3. Installation of Height restriction sensor installation
4. Modification of Recorder House A2 & weighbridges
5. Site Clearance at Portion A1

12.2 Key Issues for the Coming Month

Key issues to be considered in the coming month include:

- Chemical and waste management;
- Treatment of runoff and wastewater prior to discharge;
- Dust generated from loading and unloading activities; and
- Dust generated from dump trucks traffic.

Mitigation measures to be required in the coming month:

Air Quality Impact

- To provide adequate water spraying on haul roads and working platform;
- To operate and maintain automatic wheel washing facilities properly;
- To dampen the fill material prior to unloading or movement;
- To provide road sweeping on haul road near site egress and public roads outside site egress;
- To ensure implementation of the dust mitigation measures for the site activities;
- To maintain proper operation of the mist spraying system;
- To provide proper maintenance for vehicles and machines on site; and
- To investigate any other dust sources around the air sensitive receivers

Noise

- To switch off equipment if not in use;
- To operate silent equipment;
- To identify the noise sources inside and outside of the site;
- To follow up any exceedance caused by the Fill Bank operation; and



- To re-schedule the work activities in the event of valid noise exceedance.

Water Quality Impact

- To maintain the drainage system in the Fill Bank;
- To ensure the cleanliness of oil interceptor bypass tanks and all the drainage channels;
- To maintain the existing silt trap to ensure good efficiency of wheel wash facilities;
- To repair, inspect and maintain the silt curtains regularly;
- To provide covers for the drip trays to avoid stagnant water pond due to rainfall;
- To provide proper treatment for oily water discharged from the area around air monitoring station TKO-A1;
- To deploy a cleaning vessel to remove floating rubbish in the TKO Basin;
- To clean up the concrete paved area at Portion I every night to avoid fill materials from being washed into the sea; and
- To avoid any stagnant water or provide insecticide to avoid mosquito breeding in the Fill Bank.

Chemical and Waste Management

- To remove waste from the site regularly;
- To properly store and handle chemical wastes on site;
- To implement trip ticket system for all the imported public fill and general refuse disposal;
- To provide and manage sufficiently sized drip trays for diesel drums or chemical containers;
- To remove existing unwanted material in the stockpiles and avoid improper disposal at the Fill Bank through inspection of imported truckloads;
- To maintain proper housekeeping at the workshop area;
- To remove the oil stains in the event of leakage and handle all materials using for this cleaning works as chemical waste;
- To maintain mesh screen on top of the additional drainage, DP3 opening to avoid improper dumping of rubbish into this channel; and
- To identify C&D material by packaging, labeling, storage, transportation and disposal in accordance with statutory regulations.

12.3 Monitoring Schedule for the Coming Month

The proposed EM&A program of the coming month is attached in Appendix I M.


- END OF REPORT -



Appendix I

A

Project Organization Chart

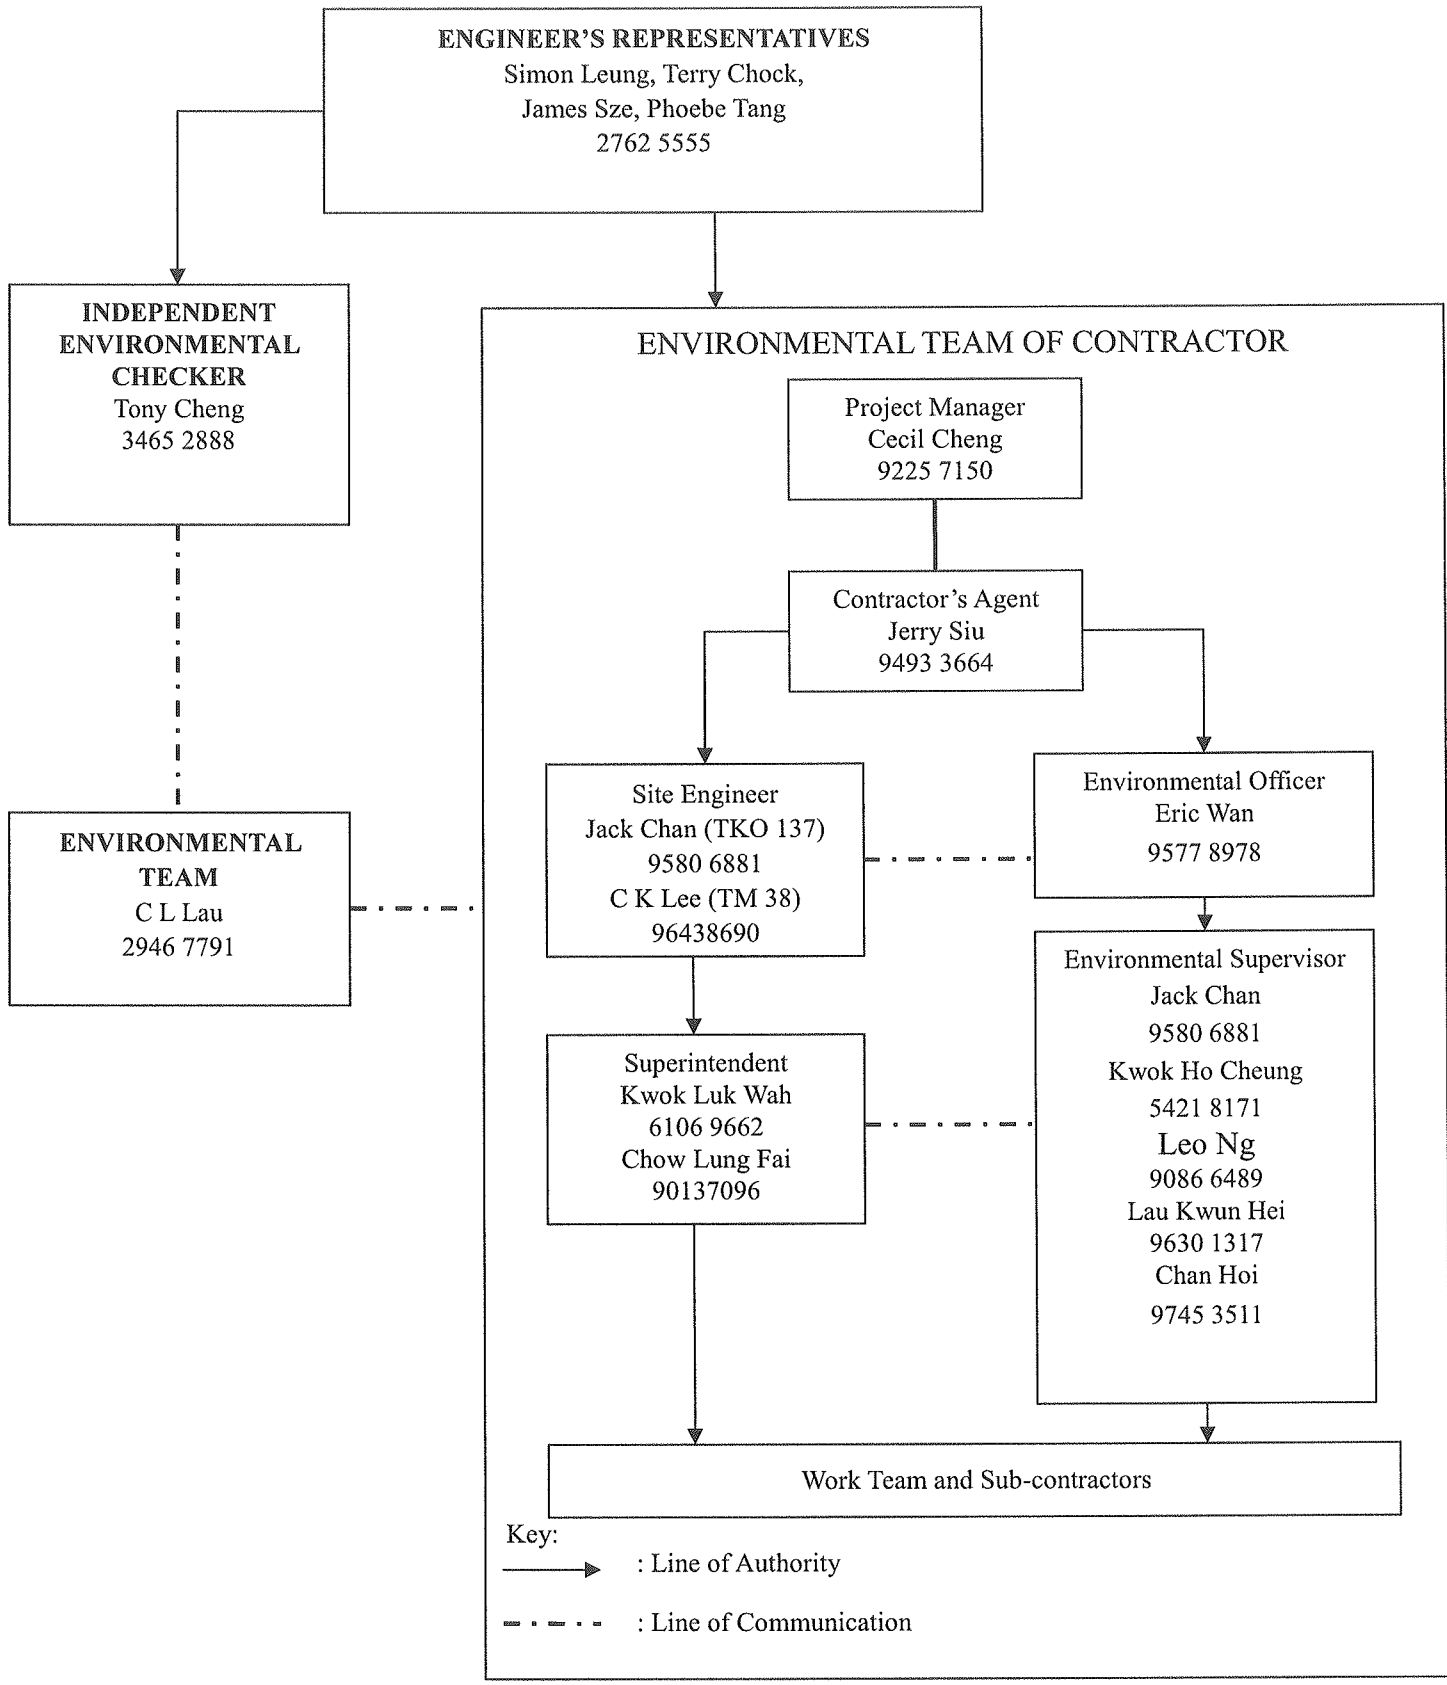




Appendix I

B1

Calibration Certificates for Impact Air Quality Monitoring Equipment

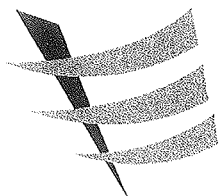

東業德勤測試顧問有限公司

ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong

Tel : 2695 8318

E-mail : etl@ets-testconsult.com

Fax : 2695 3944

Web site : www.ets-testconsult.com

Calibration Report
of
High Volume Air Sampler

Manufacturer : Graseby GMW Date of Calibration : 05 February 2016


Serial No. : 1172 (ET / EA / 003 / 11) Calibration Due Date : 04 April 2016

Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results :

Flow recorder reading (cfm)	52	49	40	36	28
Qstd (Actual flow rate, m ³ /min)	1.82	1.68	1.41	1.18	0.88
Pressure :	763.56	mm Hg	Temp. :	284	K

Sampler 1172 Calibration Curve
Site: Tseung Kwan O 137 (TKO-A2a)

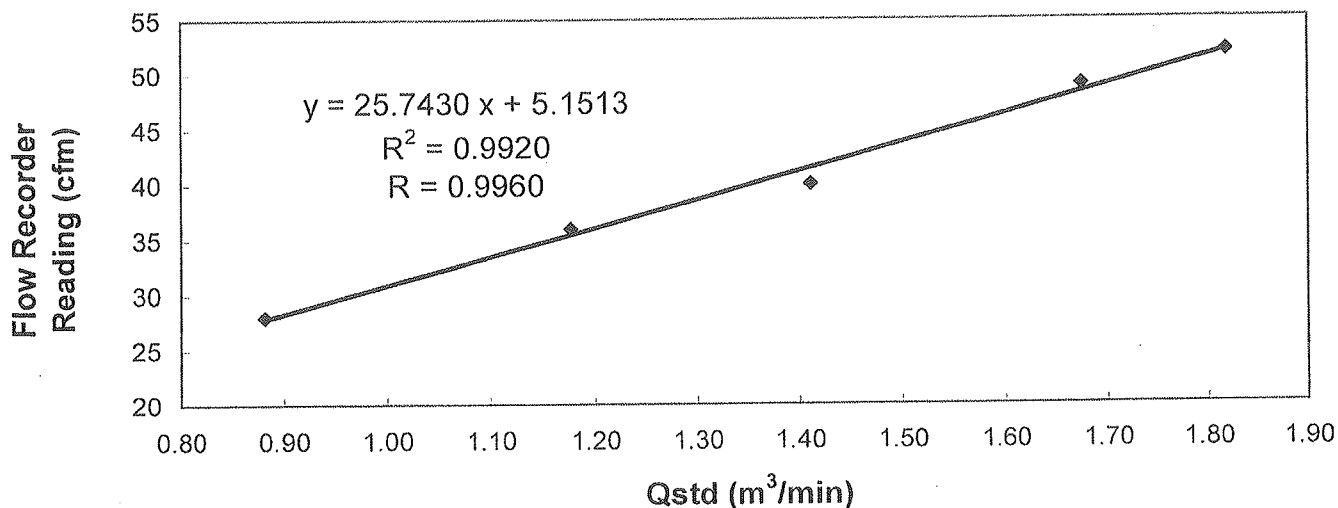

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies* / ~~does not comply*~~ with the specified requirements and is deemed acceptable* / unacceptable* for use.

Calibrated by :

TANG, Chung Hang
(Assistant Supervisor)

Checked by :

LAW, Sau Yee
(Senior Environmental Officer)

- END OF REPORT -

61/6A/004/12



TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE
 VILLAGE OF CLEVELAND, OH
 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - May 12, 2015 Rootmeter S/N 0438320 Ta (K) - 293
 Operator Tisch Orifice I.D. - 2943 Pa (mm) - 751.84

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.4710	3.2	2.00
2	NA	NA	1.00	1.0350	6.4	4.00
3	NA	NA	1.00	0.9200	7.9	5.00
4	NA	NA	1.00	0.8760	8.7	5.50
5	NA	NA	1.00	0.7220	12.6	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0018	0.6810	1.4186	0.9957	0.6769	0.8828
0.9976	0.9639	2.0061	0.9915	0.9580	1.2485
0.9955	1.0820	2.2429	0.9894	1.0754	1.3959
0.9945	1.1352	2.3524	0.9884	1.1283	1.4640
0.9892	1.3701	2.8371	0.9832	1.3618	1.7657
Qstd slope (m) = 2.05628			Qa slope (m) = 1.28761		
intercept (b) = 0.01949			intercept (b) = 0.01213		
coefficient (r) = 0.99997			coefficient (r) = 0.99997		

y axis = SQRT[H2O (Pa/760) (298/Ta)]

y axis = SQRT[H2O (Ta/Pa)]

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
 Qa = Va/Time

For subsequent flow rate calculations:

Qstd = 1/m{ [SQRT(H2O (Pa/760) (298/Ta))] - b}
 Qa = 1/m{ [SQRT H2O (Ta/Pa)] - b}



Appendix I

B2

Impact Air Quality Monitoring Results

Summary of 24-hr TSP Monitoring Results

Monitoring Station : TKO-A1
Location : Site Egress

Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
05/03/16	08:00	06/03/16	08:00	24468.33	24492.33	24.00	1.0307	1.0307	1.0307	2.7439	2.9226	120
11/03/16	13:00	12/03/16	13:00	24496.33	24520.33	24.00	1.0307	1.0307	1.0307	2.7836	2.9015	77
17/03/16	08:00	18/03/16	08:00	24522.33	24546.33	24.00	1.0307	1.0307	1.0307	2.7813	2.8892	73
23/03/16	13:00	24/03/16	13:00	24552.33	24576.33	24.00	1.0307	1.0307	1.0307	2.7831	2.8879	71
29/03/16	08:00	30/03/16	08:00	24576.33	24600.33	24.00	1.0307	1.0307	1.0307	2.7817	2.8866	71

Monitoring Station : TKO-A2a
Location : CREO

Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
05/03/16	08:00	06/03/16	08:00	24477.64	24501.64	24.00	1.0430	1.0430	1.0430	2.7808	2.9237	95
11/03/16	13:05	12/03/16	13:05	24505.64	24529.64	24.00	1.0430	1.0430	1.0430	2.8051	2.9097	70
17/03/16	08:00	18/03/16	08:00	24531.64	24555.64	24.00	1.0430	1.0430	1.0430	2.8095	2.9230	76
23/03/16	13:05	24/03/16	13:05	24561.64	24585.64	24.00	1.0430	1.0430	1.0430	2.7795	2.8947	77
29/03/16	08:00	30/03/16	08:00	24585.64	24609.64	24.00	1.0430	1.0430	1.0430	2.8005	2.9157	77

Summary of 1-hr TSP Monitoring Results

Monitoring Station : TKO-A1
Location : Site Egress

Date	Time		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
02/03/16	09:45	10:45	24466.33	24467.33	1.00	1.0307	1.0307	1.0307	2.7439	2.7586	238
04/03/16	08:10	09:10	24467.33	24468.33	1.00	1.0307	1.0307	1.0307	2.7232	2.7371	225
07/03/16	09:45	10:45	24492.33	24493.33	1.00	1.0307	1.0307	1.0307	2.7866	2.7981	186
07/03/16	10:45	11:45	24493.33	24494.33	1.00	1.0307	1.0307	1.0307	2.7816	2.7937	196
09/03/16	09:55	10:55	24494.33	24495.33	1.00	1.0307	1.0307	1.0307	2.7816	2.7951	218
11/03/16	08:00	09:00	24495.33	24496.33	1.00	1.0307	1.0307	1.0307	2.7817	2.7932	186
14/03/16	09:25	10:25	24520.33	24521.33	1.00	1.0307	1.0307	1.0307	2.7894	2.8019	202
16/03/16	08:00	09:00	24521.33	24522.33	1.00	1.0307	1.0307	1.0307	2.7903	2.8030	205
18/03/16	18:28	19:28	24546.33	24547.33	1.00	1.0307	1.0307	1.0307	2.7888	2.8013	202
21/03/16	08:25	09:25	24547.33	24548.33	1.00	1.0307	1.0307	1.0307	2.7951	2.8086	218
21/03/16	13:50	14:50	24548.33	24549.33	1.00	1.0307	1.0307	1.0307	2.7851	2.7980	209
23/03/16	10:00	11:00	24549.33	24550.33	1.00	1.0307	1.0307	1.0307	2.7124	2.7227	167
23/03/16	11:00	12:00	24550.33	24551.33	1.00	1.0307	1.0307	1.0307	2.8003	2.8117	184
23/03/16	12:00	13:00	24551.33	24552.33	1.00	1.0307	1.0307	1.0307	2.8123	2.8244	196
30/03/16	08:30	09:30	24600.33	24601.33	1.00	1.0307	1.0307	1.0307	2.7822	2.7952	210
30/03/16	09:30	10:30	24601.33	24602.33	1.00	1.0307	1.0307	1.0307	2.7835	2.7956	196

Monitoring Station : TKO-A2a
Location : CREO

Date	Time		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
02/03/16	09:55	10:55	24475.64	24476.64	1.00	1.0430	1.0430	1.0430	2.7678	2.7798	192
04/03/16	08:20	09:20	24476.64	24477.64	1.00	1.0430	1.0430	1.0430	2.7501	2.7611	176
07/03/16	09:50	10:50	24501.64	24502.64	1.00	1.0430	1.0430	1.0430	2.8125	2.8231	169
07/03/16	10:50	11:50	24502.64	24503.64	1.00	1.0430	1.0430	1.0430	2.8054	2.8158	166
09/03/16	08:10	09:10	24503.64	24504.64	1.00	1.0430	1.0430	1.0430	2.8044	2.8165	193
11/03/16	09:30	10:30	24504.64	24505.64	1.00	1.0430	1.0430	1.0430	2.8044	2.8164	192
14/03/16	09:30	10:30	24529.64	24530.64	1.00	1.0430	1.0430	1.0430	2.8055	2.8162	171
16/03/16	08:10	09:10	24530.64	24531.64	1.00	1.0430	1.0430	1.0430	2.8051	2.8160	174
18/03/16	18:31	19:31	24555.64	24556.64	1.00	1.0430	1.0430	1.0430	2.8077	2.8208	209
21/03/16	08:35	09:35	24556.64	24557.64	1.00	1.0430	1.0430	1.0430	2.8052	2.8173	193
21/03/16	13:55	14:55	24557.64	24558.64	1.00	1.0430	1.0430	1.0430	2.8034	2.8171	219
23/03/16	10:05	11:05	24558.64	24559.64	1.00	1.0430	1.0430	1.0430	2.8043	2.8167	198
23/03/16	11:05	12:05	24559.64	24560.64	1.00	1.0430	1.0430	1.0430	2.7921	2.8041	192
23/03/16	12:05	13:05	24560.64	24561.64	1.00	1.0430	1.0430	1.0430	2.7925	2.8059	214
30/03/16	08:35	09:35	24609.64	24610.64	1.00	1.0430	1.0430	1.0430	2.7767	2.7892	200
30/03/16	09:35	10:35	24610.64	24611.64	1.00	1.0430	1.0430	1.0430	2.7774	2.7911	219




Appendix I

B3


Graphical Plots of Impact Air Quality Monitoring Data




24-hour TSP level at TKO-A1

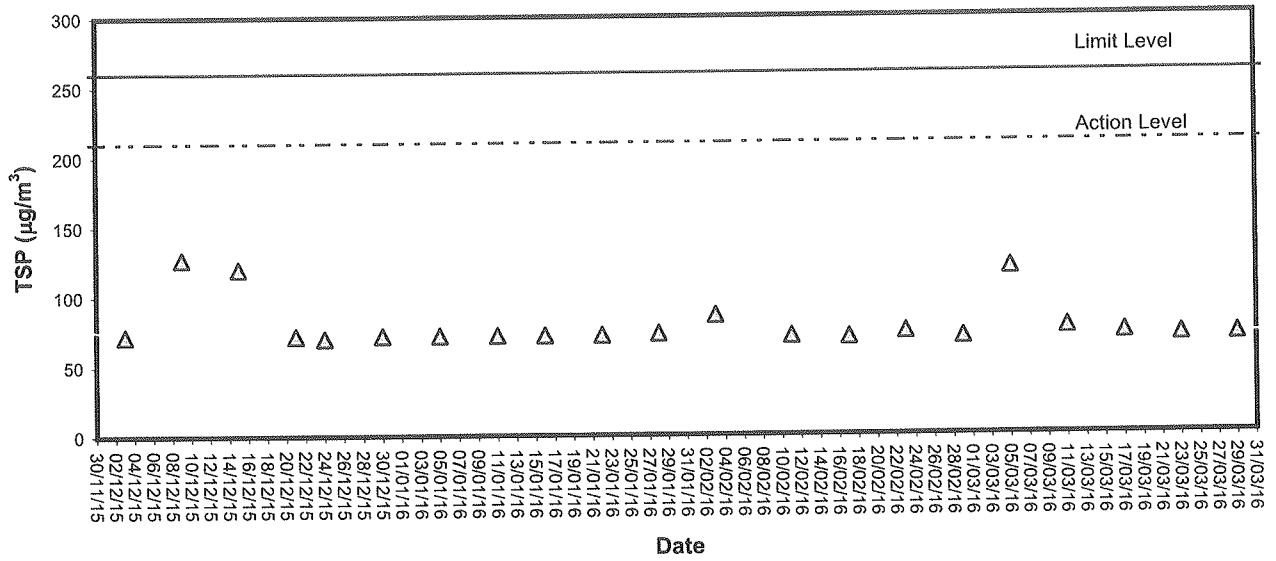


24-hour TSP level at TKO-A2a

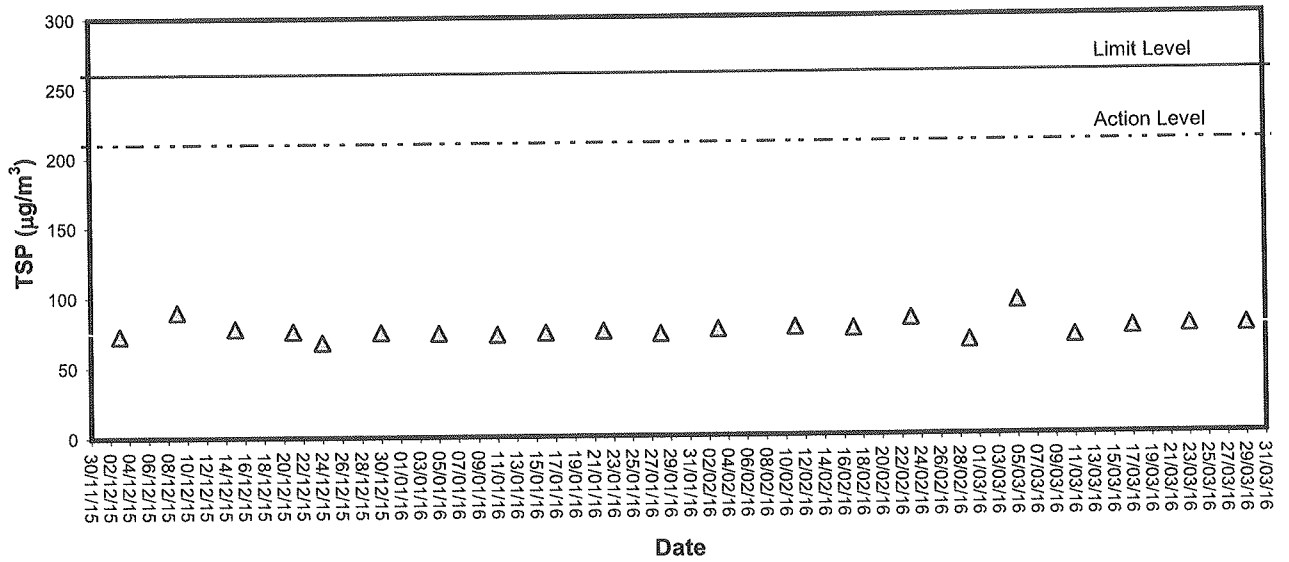

1-hour TSP level at TKO-A1

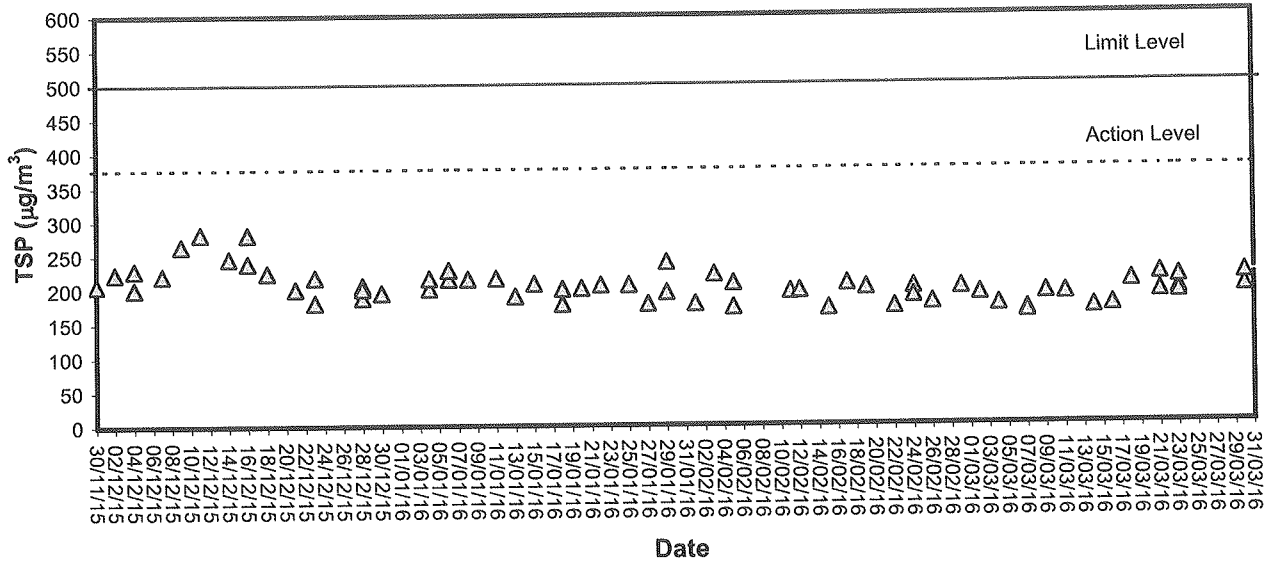

1-hour TSP level at TKO-A2a

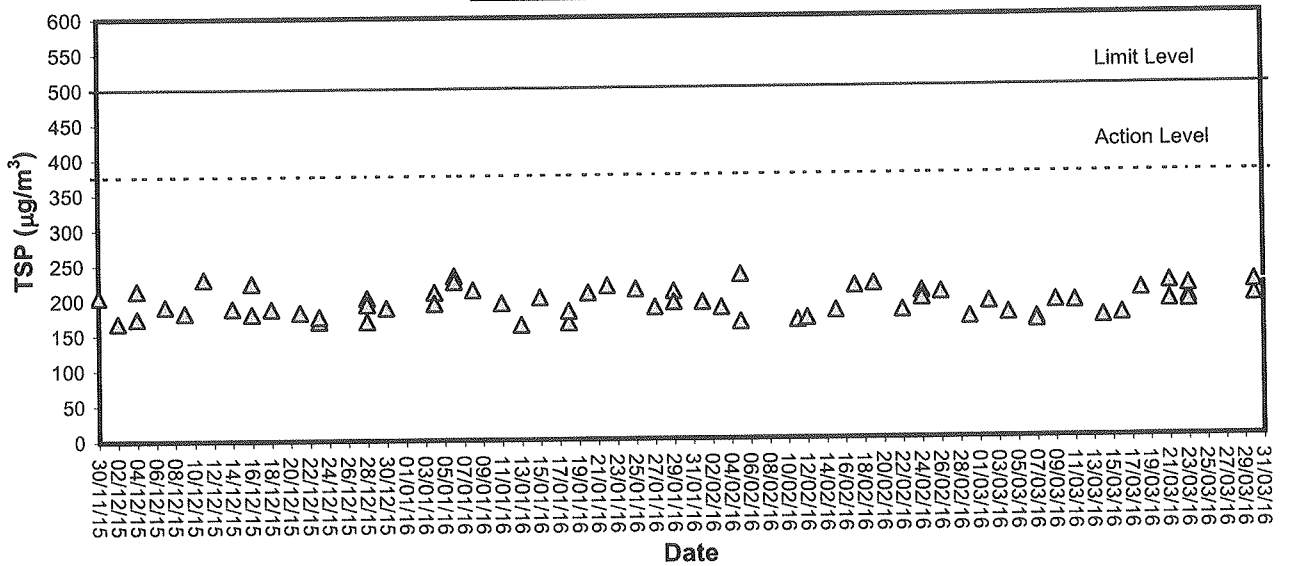



Appendix I

C1

Calibration Certificates for Impact Noise Monitoring Equipment



Calibration Certificate

Certificate No. **508914**

Page 1 of 2 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q53461

Date of receipt : 13-Oct-15

Item Tested

Description : Sound Level Calibrator (ET/EN/002/01)

Manufacturer : Rion

Model : NC-73

Serial No. : 10196943

Test Conditions

Date of Test : 29-Oct-15

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : F21, Z02.

Test Results

All results were within the manufacturer's specification.

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S014	Spectrum Analyzer	505317	NIM-PRC & SCL-HKSAR
S240	Sound Level Calibrator	500563	NIM-PRC & SCL-HKSAR
S041	Universal Counter	506951	SCL-HKSAR
S206	Sound Level Meter	506958	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).
The test results apply to the above Unit-Under-Test only

Calibrated by : 
Alan Chu

Approved by : 
Steve Kwan

Date: 29-Oct-15

This Certificate is issued by:
Hong Kong Calibration Ltd.
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.
Tel: 2425 8801 Fax: 2425 8646



Calibration Certificate

Certificate No. 508914

Page 2 of 2 Pages

Results :

1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94 dB	94.1 dB	± 1 dB

Uncertainty : ± 0.2 dB

2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	1.014 kHz	± 2 %

Uncertainty : ± 0.1 %

3. Level Stability : 0.0 dB

Uncertainty : ± 0.01 dB

4. Total Harmonic Distortion : < 1.0 %

Mfr's Spec. : < 3 %

Uncertainty : ± 2.3 % of reading

Remarks: 1. UUT : Unit-Under-Test
2. The uncertainty claimed is for a confidence probability of not less than 95%.
3. Atmospheric Pressure : 1013 hPa

----- END -----

TEST REPORT
for
PRECISION
SOUND LEVEL METER
(NX-42EX installed)

Model : N L - 5 2

Serial No. : 00253765

Microphone No. : 07824

Preamplifier No. : 43795

Condition : Temperature 26 °C

Humidity 53 %RH

Date : May, 20, 2015

Signature :

Y. Kitajima

Pass

1. Frequency weightings (Fig. 1)

- Frequency weighting A
- Frequency weighting C
- Frequency weighting Z

2. Level linearity error (dB)

Reference signal level (Ref.) : 94.0 dB (at 1 kHz, 8 kHz), 74.0 dB (at 31.5 Hz)

Frequency weighting : A

Frequency	Indicated value	Difference with Reference signal level (dB)					
		25.0	74.0	94.0	98.0	114.0	136.0
31.5 Hz	-0.1	Ref.	—	-0.1	—	—	—
1 kHz	0.0	—	Ref.	—	0.0	—	0.0
8 kHz	0.0	—	Ref.	—	—	0.0	—
Tolerance limit	±0.3	—	—	±0.3	±0.2	±0.3	±0.3

3. Toneburst response (Time weighted sound level)

Input signal level : 127 dB

Toneburst : Frequency : 4 kHz, duration : 0.25 ms

Frequency weighting : A, Time-weighting : F

(dB)			
Design goal	Indicated value	Difference	Tolerance limit
100.0	99.7	-0.3	±1.0

4. Time weighting I (impulse)

Input signal level : 120 dB

Toneburst : Frequency : 4 kHz, duration : 5 ms, period : 500 ms

Frequency weighting : A

(dB)			
Design goal	Indicated value	Difference	Tolerance limit
111.2	110.5	-0.7	±2.0

*When the optional Extended Function Program NX-42EX is installed, time weighting I(impulse) can be selected in only sub-channel.

5. Peak sound level (dB)

Frequency weighting : C

Frequency (Hz)	Number of cycles in test signal	(dB)				
		Input signal level	Design goal	Indicated value	Difference	Tolerance limit
			L_c	L_{cpeak}		
31.5	1 cycle	137.0	136.5	137.3	0.8	±2.0
500	Positive half cycle	137.0	139.4	139.2	-0.2	±1.0
	Negative half cycle	137.0	139.4	139.2	-0.2	±1.0

6. Response to repeated toneburst

Input signal level : 130.0 dB + 8 dB

Frequency weighting : A, Time-weighting : S

Toneburst : Frequency : 2 kHz, duration : 5 ms, period : 25 ms

(dB)				
Peak-to-rms ratio	Design goal	Indicated value	Difference	Tolerance limit
3.16	131.0	131.0	0.0	±0.5

7. Inherent noise level (dB)

(dB)		
Frequency weighting	Indicated value	Tolerance limit
A	11.6	17 or less
C	16.0	25 or less
Z	21.6	30 or less

8. Instrumental error

84.0 dB ± 0.7 dB

0.1 dB

Applicable standards

JIS C 1509-1 : 2005 Class 1

IEC 61672-1 : 2002 Class 1

ANSI S1.4-1983 Type 1

ANSI S1.43-1997 Type 1




CE marking (EMC Directive 2004/108/EC, Low Voltage Directive 2006/95/EC)

WEEE Directive (2002/96/EC)

Chinese RoHS



Relative free field frequency response

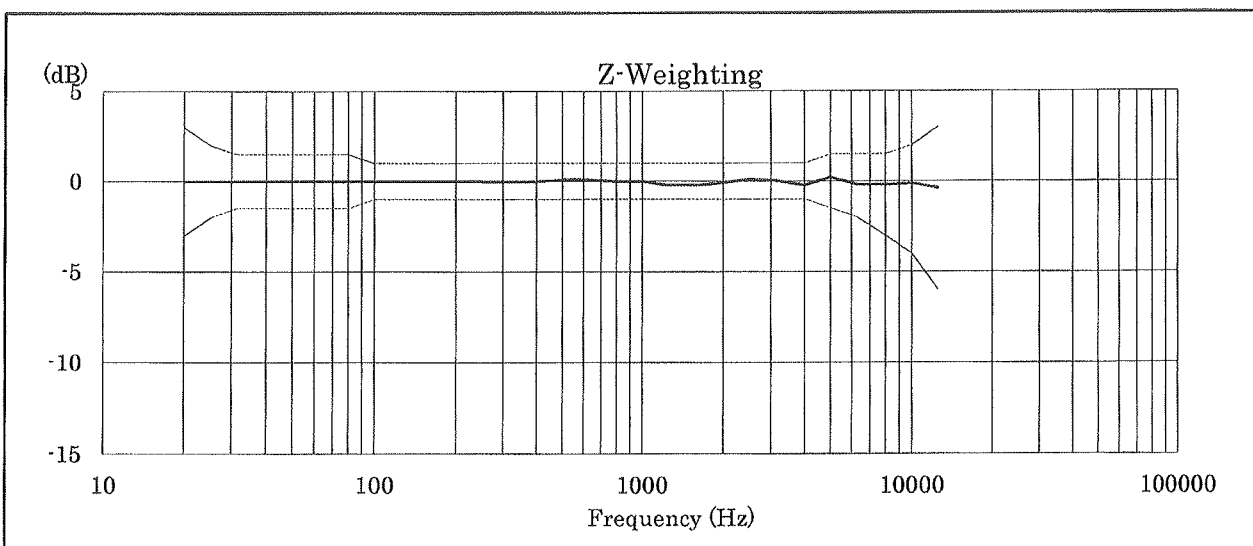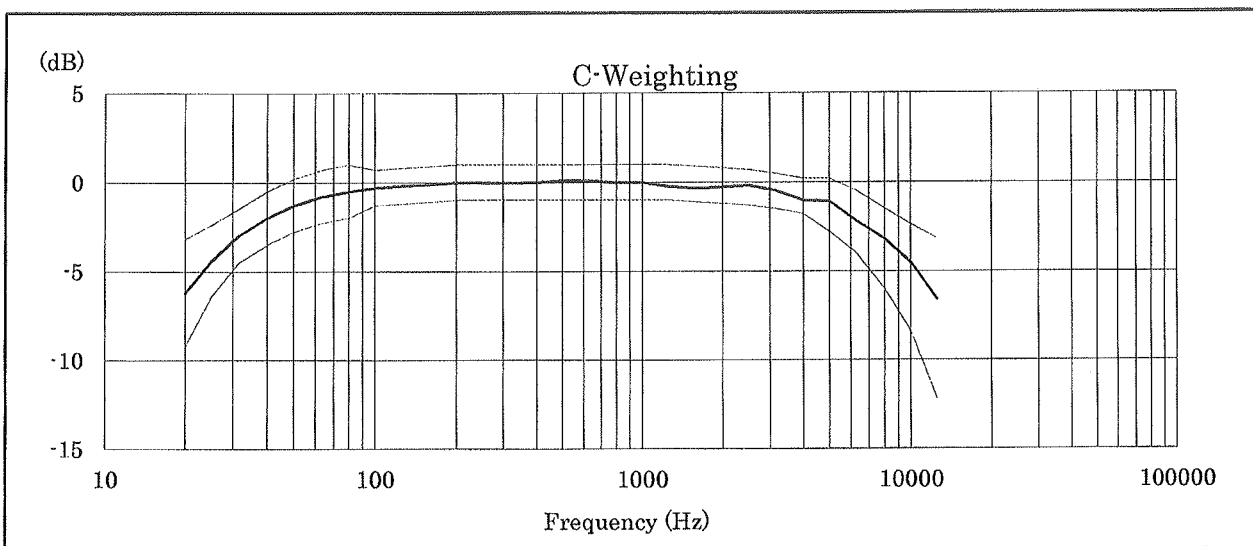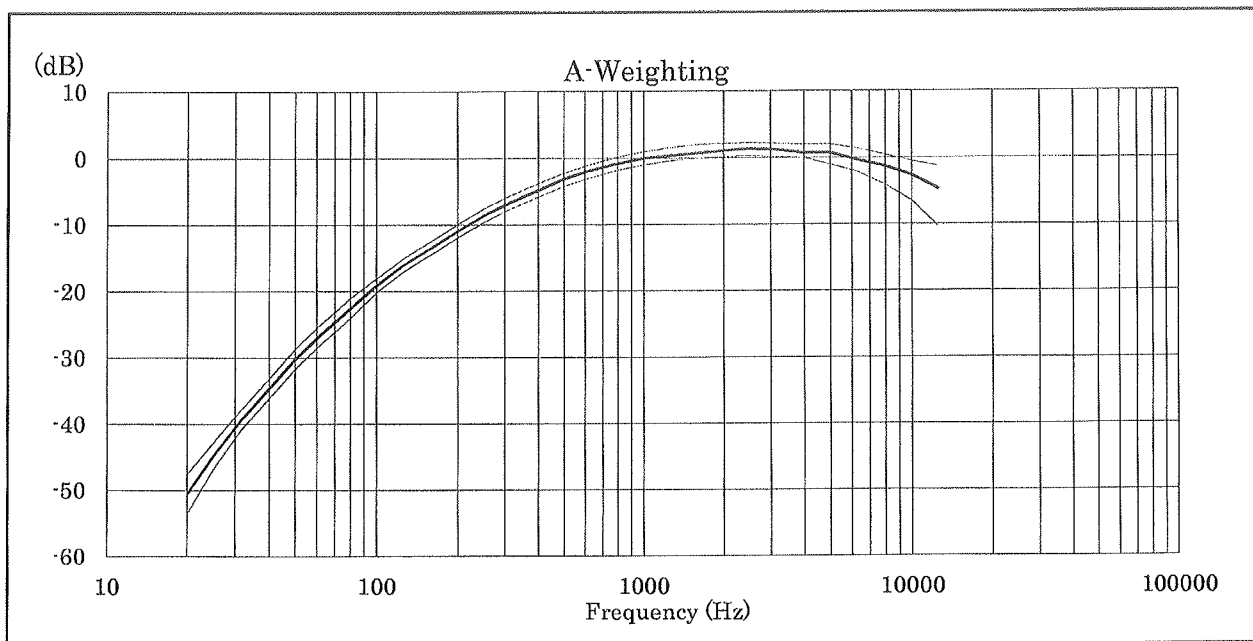



Appendix I

C2

Impact Noise Monitoring Results

Day-time Noise Monitoring

Monitoring Location: TKO-N1 (Site Egress)


Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq} (30min)	L ₁₀	L ₉₀		
09/03/16	09:25	67.9	70.8	65.2	0.3	Cloudy




Appendix I

C3

Graphical Plots of Impact Noise Monitoring Data



Noise Monitoring (Day-time)

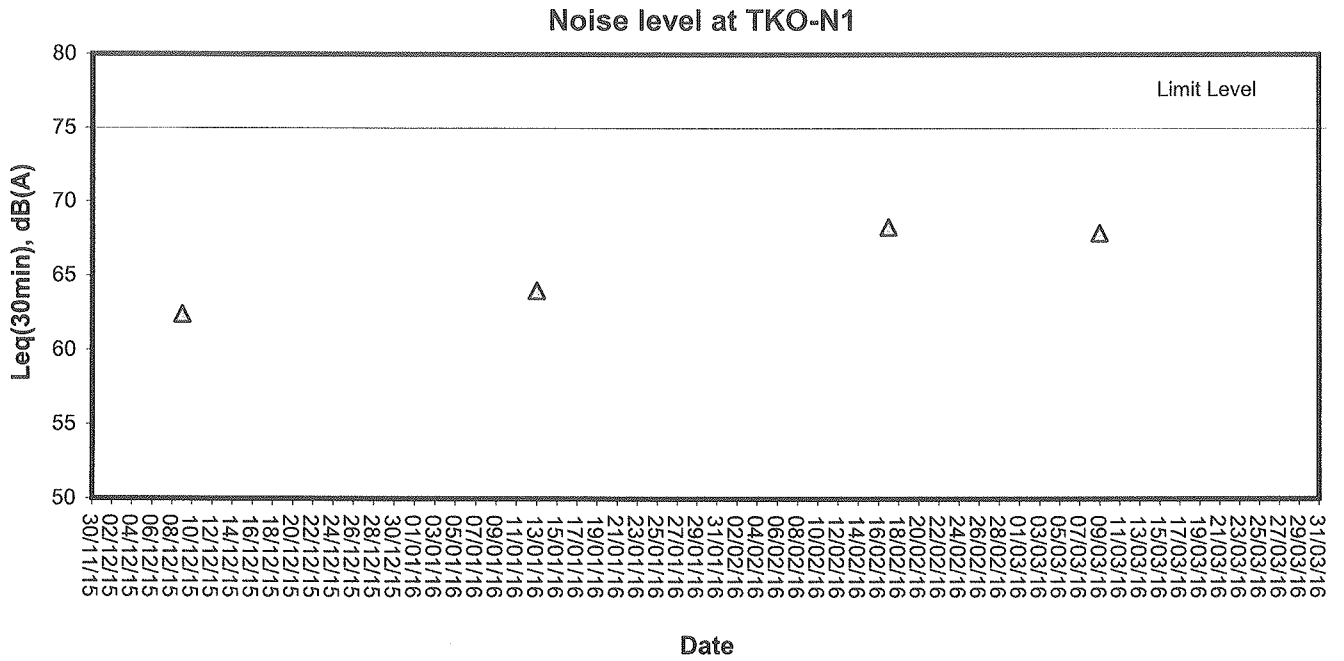



Appendix I

D1

Calibration Certificates for Impact Marine Water Quality Monitoring Equipments



Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/001</u>	Manufacturer : <u>YSI</u>
Model No. : <u>85</u>	Serial No. : <u>05L 1285</u>
Date of Calibration : <u>30/01/2016</u>	Calibration Due Date : <u>29/04/2016</u>

Temperature Verification

Ref. No. of Reference Thermometer : ET/0521/017

Ref. No. of Water Bath : ---

		Temperature (°C)		
Reference Thermometer reading	Measured	20.0	Corrected	19.9
DO Meter reading	Measured	20.0	Difference	-0.1

Standardization of sodium thiosulphate (Na₂S₂O₃) solution

Reagent No. of Na ₂ S ₂ O ₃ titrant	CPE/012/4.5/001/13	Reagent No. of 0.025N K ₂ Cr ₂ O ₇	CPE/012/4.4/002/06
		Trial 1	Trial 2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)		0.00	10.20
Final Vol. of Na ₂ S ₂ O ₃ (ml)		10.20	20.50
Vol. of Na ₂ S ₂ O ₃ used (ml)		10.20	10.30
Normality of Na ₂ S ₂ O ₃ solution (N)		0.02451	0.02427
Average Normality (N) of Na ₂ S ₂ O ₃ solution (N)		0.02439	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na₂S₂O₃, N = 0.25 / ml Na₂S₂O₃ used

Linearity Checking

Determination of dissolved oxygen content by Winkler Titration *

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	11.10	22.00	0.00	6.90	10.40
Final Vol. of Na ₂ S ₂ O ₃ (ml)	11.10	22.00	28.80	6.90	10.40	14.20
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	11.10	10.90	6.80	6.90	3.50	3.80
Dissolved Oxygen (DO), mg/L	7.27	7.14	4.45	4.52	2.29	2.49
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.28	7.31	7.30	7.27	7.14	7.21	1.24
5	4.22	4.26	4.24	4.45	4.52	4.49	5.73
10	2.28	2.33	2.31	2.29	2.49	2.39	3.40
Linear regression coefficient				0.9969			

Internal Calibration Report of Dissolved Oxygen Meter

Zero Point Checking

DO meter reading, mg/L	0.00
------------------------	------

Salinity Checking

Reagent No. of NaCl (10ppt)	CPE/012/4.7/003/14	Reagent No. of NaCl (30ppt)	CPE/012/4.8/003/14
-----------------------------	--------------------	-----------------------------	--------------------

Determination of dissolved oxygen content by Winkler Titration **

Salinity (ppt)	10		30	
	1	2	1	2
Trial				
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	11.40	22.80	32.50
Final Vol. of Na ₂ S ₂ O ₃ (ml)	11.40	22.80	32.50	42.10
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	11.40	11.40	9.70	9.60
Dissolved Oxygen (DO), mg/L	7.46	7.46	6.35	6.29
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.22	7.29	7.26	7.46	7.46	7.46	2.72
30	6.44	6.40	6.42	6.35	6.29	6.32	1.57

Acceptance Criteria

- (1) Differenc between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / ~~does not comply~~ # with the specified requirements and is deemed acceptable # / unacceptable # for use.


Delete as appropriate

Calibrated by

:



Approved by :





Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/001 Manufacturer : YSI
Model No. : 85 Serial No. : 05L 1285
Date of Calibration : ²⁶ ~~30~~/01/2016 Due Date : ²⁵ ~~29~~/04/2016

Ref. No. of Salinity Standard used (30ppt)

S/001/6

Salinity Standard (ppt)	Measured Salinity (ppt)	Difference * (%)
30.0	30.6	2.00

(*) Difference (%) = (Measured Salinity – Salinity Standard value) / Salinity Standard value x 100

Acceptance Criteria

Difference : -10 % to 10 %

The salinity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Checked by :

Approved by :



Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/012 Manufacturer : HACH

Model No. : 2100Q Serial No. : 12060 C 018447

Date of Calibration : 30/12/2015 Due Date : 29/03/2016

Ref. No. of Turbidity Standard used (4000NTU)

005/6.1/001/8

Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	20.6	2.50
100	99.2	0.80
800	777	-2.88


(*) Difference = (Measured Value – Theoretical Value) / Theoretical Value x 100

Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 



Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/012 Manufacturer : HACH

Model No. : 2100Q Serial No. : 12060 C 018447

Date of Calibration : 29/03/2016 Due Date : 28/06/2016

Ref. No. of Turbidity Standard used (4000NTU)

005/6.1/001/9

Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	19.5	-2.50
100	98.2	-1.80
800	768	-4.00


(*) Difference = (Measured Value – Theoretical Value) / Theoretical Value x 100


Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 



Appendix I

D2

Impact Marine Water Quality Monitoring Results

Mid-Flood Tide



東業 經 動 測 試 廣 國 有 限 公 司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)						
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Depth-average	
02/03/16	1030-1045	15/Cloudy	Surface	1.0	15.6	28.1	28.1	7.21	7.19	85.9	85.8	2.14	2.12	3.2	3.1	3.4	3.4	3.4	3.4	3.4	3.4		
			Middle	10.0	15.4	28.2	28.3	7.14	7.12	85.0	84.8	2.21	2.19	2.10	2.19							2.9	3.5
			Bottom	19.0	15.1	28.3	28.5	7.10	7.00	84.6	82.8	2.17	2.40	2.37	2.40							3.3	3.3
04/03/16	1230-1246	18/Fine	Surface	1.0	15.6	28.0	28.0	6.99	7.14	85.5	85.3	1.13	1.17	1.7	1.8	1.9	1.9	1.9	1.9	1.9	1.9		
			Middle	9.9	15.5	28.1	28.1	7.07	7.06	84.2	84.0	1.20	1.22	1.19	1.22							1.8	1.7
			Bottom	18.8	15.2	28.1	28.5	7.05	6.91	83.8	82.0	1.25	1.53	1.19	1.53							1.8	2.3
07/03/16	1530-1548	16/Cloudy	Surface	1.0	15.7	27.6	27.6	6.93	6.91	87.2	87.1	1.31	1.29	1.8	1.9	2.0	2.0	2.0	2.0	2.0	2.0		
			Middle	9.9	15.6	27.8	27.9	6.73	6.74	84.7	84.9	1.38	1.36	1.27	1.36							1.7	2.0
			Bottom	18.8	15.5	28.0	28.1	6.58	6.60	82.7	83.0	1.34	1.63	1.67	1.63							2.5	2.3
09/03/16	1630-1648	18/Cloudy	Surface	1.0	15.4	28.3	28.4	6.61	6.87	82.3	81.9	1.37	1.35	2.1	2.1	2.2	2.2	2.2	2.2	2.2	2.2		
			Middle	9.5	15.3	28.5	28.5	6.85	6.84	81.4	81.2	1.44	1.43	2.0	2.3							1.7	2.3
			Bottom	18.0	15.0	28.7	28.8	6.76	6.78	80.0	80.3	1.42	1.69	1.73	1.69							2.4	2.6
11/03/16	0800-0814	16/Cloudy	Surface	1.0	15.3	28.3	28.3	6.94	6.96	82.6	82.9	2.34	2.33	3.3	3.2	3.5	3.5	3.5	3.5	3.5	3.5		
			Middle	9.4	15.1	28.2	28.2	6.92	6.93	82.3	82.4	2.31	2.46	3.0	2.46							3.3	3.7
			Bottom	17.8	15.2	28.2	28.2	6.93	6.76	80.2	80.4	2.45	2.54	2.46	2.45							3.4	3.4
14/03/16	0900-0918	16/Cloudy	Surface	1.0	17.0	27.7	27.8	6.77	8.03	80.6	98.6	2.51	1.84	3.8	2.6	2.9	2.9	2.9	2.9	2.9	2.9		
			Middle	9.7	17.1	28.2	27.9	7.80	7.99	98.4	97.9	2.56	2.00	3.6	3.0							2.6	3.0
			Bottom	18.4	17.0	28.1	28.1	7.83	7.82	98.0	95.9	2.66	2.26	2.6	2.26							3.1	3.1
16/03/16	1030-1045	15/Cloudy	Surface	1.0	16.9	30.6	30.7	7.87	7.88	97.8	97.9	1.03	1.04	1.5	1.5	2.4	2.4	2.4	2.4	2.4	2.4		
			Middle	10.0	17.0	30.3	30.4	7.89	7.90	98.0	97.3	1.05	2.11	1.4	2.11							1.5	2.7
			Bottom	18.9	17.0	30.3	30.3	7.90	8.05	97.3	98.9	2.12	2.14	1.4	2.14							1.4	2.8
18/03/16	1305-1318	18/Cloudy	Surface	1.0	17.6	30.5	30.4	7.09	7.09	90.3	89.9	2.06	2.08	3.1	3.3	4.1	4.1	4.1	4.1	4.1	4.1		
			Middle	8.9	17.5	30.3	30.5	7.28	7.26	88.8	88.7	2.10	2.89	3.4	4.4							2.8	4.4
			Bottom	16.7	17.3	30.3	30.4	7.23	7.22	88.5	92.8	2.87	3.27	4.4	4.5							2.8	4.5

Mid-Flood Tide



東業 德 動 測 試 顧 問 有 限 公 司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Middle		Bottom	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
21/03/16	1600-1614	17/Cloudy	Surface	1.0	18.0	27.3	27.3	6.84	6.83	82.1	82.0	2.26	2.28	3.2	3.2	3.3			
						27.3	27.3	6.82	6.78	81.8	2.30	3.2							
						27.4	27.4	6.79	6.78	81.5	2.39	3.8							
			Middle	9.5	17.9	27.3	27.3	6.76	6.76	81.2	2.43	2.41	3.2	3.5					
						27.3	27.3	6.74	6.76	80.9	2.48	3.0							
						27.3	27.3	6.78	6.76	81.4	2.52	3.5							
			Bottom	18.0	17.9	28.7	29.1	6.96	7.00	88.3	88.7	2.38	2.32	3.8	3.6				
						29.5	29.1	7.04	7.00	89.1	2.25	3.4							
						29.3	29.6	6.88	6.96	87.1	2.95	4.7							
23/03/16	1636-1651	18/Cloudy	Surface	1.0	17.8	29.8	29.6	7.03	6.96	88.8	88.0	2.83	2.89	4.7	4.2				
						29.8	29.6	6.98	7.01	87.8	2.79	3.7							
						28.9	29.2	7.04	7.01	87.1	3.18	5.0							
			Middle	8.8	17.9	29.7	29.8	7.01	7.03	88.3	88.2	2.39	2.37	3.1	3.1				
						29.8	29.8	7.01	7.03	88.0	2.34	3.0							
						29.9	30.0	6.94	6.99	87.4	2.66	4.0							
			Bottom	16.6	18.1	30.0	30.0	7.03	6.99	88.5	88.0	2.69	2.68	4.3	4.2				
						29.9	29.9	7.08	7.05	89.5	2.86	4.3							
						29.4	29.2	6.98	7.01	87.1	3.18	5.1							
30/03/16	0830-0848	18/Cloudy	Surface	1.0	17.7	29.7	29.8	7.01	7.03	88.3	88.2	2.39	2.37	3.1	3.1				
						29.8	29.8	7.01	7.03	88.0	2.34	3.0							
						29.9	30.0	6.94	6.99	87.4	2.66	4.0							
			Middle	8.7	17.8	30.0	30.0	7.03	6.99	88.5	88.0	2.69	2.68	4.3	4.2				
						29.9	29.9	7.08	7.05	89.5	2.86	4.3							
						29.8	29.9	7.01	7.05	88.5	2.82	4.2							
			Bottom	16.4	18.0	29.9	29.9	7.08	7.05	89.5	89.0	2.86	2.84	4.3	4.3				
						29.9	29.9	7.08	7.05	89.5	2.86	4.3							
						29.8	29.8	7.01	7.05	88.5	2.82	4.2							

Mid-Flood Tide



東業德測試顧問有限公司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	
02/03/16	1210-1230	15/Cloudy	Surface	15.5	28.0	28.1	7.07	7.06	84.1	83.9	2.03	2.07	3.2	3.2	3.2			
			Middle	15.4	28.1	7.05	7.01	83.7	85.1	2.11	2.15	3.2	3.1					
			Bottom	15.3	28.1	7.00	6.92	85.0	82.1	2.17	2.31	2.8	3.4					
04/03/16	1348-1406	18/Fine	Surface	15.5	28.2	28.3	6.93	6.92	82.3	84.6	2.24	1.08	1.5	1.6	1.8			
			Middle	15.5	28.0	7.10	7.03	84.9	83.8	1.05	1.14	1.7	1.7					
			Bottom	15.3	28.1	7.01	6.94	84.3	82.2	1.11	1.28	1.7	2.0					
07/03/16	1710-1730	16/Cloudy	Surface	15.5	28.3	27.7	6.69	6.70	84.2	84.3	1.18	1.15	1.8	1.7	1.8			
			Middle	15.6	27.7	6.62	6.63	84.4	83.5	1.12	1.21	1.5	2.0					
			Bottom	15.6	28.0	6.64	6.54	83.3	82.3	1.22	1.36	2.0	1.9					
09/03/16	1810-1830	18/Cloudy	Surface	15.1	28.3	28.4	6.55	6.54	82.4	82.9	1.38	1.21	1.8	1.9	1.9			
			Middle	15.1	27.8	6.97	6.90	83.7	81.7	1.24	1.28	1.9	2.0					
			Bottom	15.1	28.5	6.88	6.83	82.2	81.1	1.34	1.42	1.8	2.0					
11/03/16	0901-0916	16/Cloudy	Surface	15.1	28.2	28.2	6.82	6.81	81.2	81.1	2.39	2.43	3.3	3.4	3.7			
			Middle	15.1	28.2	6.76	6.78	80.4	80.6	2.46	2.56	3.3	3.7					
			Bottom	15.0	28.2	6.79	6.66	80.8	79.3	2.59	2.69	3.9	3.9					
14/03/16	1040-1100	16/Cloudy	Surface	17.1	28.2	28.2	6.64	6.66	79.0	79.9	2.71	1.93	2.7	2.9	2.9			
			Middle	17.1	27.6	8.14	8.16	99.6	99.9	1.91	2.08	3.1	2.8					
			Bottom	16.9	27.7	8.05	8.04	100.1	98.6	1.94	2.15	2.7	3.0					
16/03/16	1132-1145	15/Cloudy	Surface	16.4	30.5	30.6	7.35	7.36	91.4	91.6	3.46	3.47	4.2	4.6	4.0			
			Middle	16.7	30.7	7.31	7.33	91.8	90.5	3.48	2.26	4.9	3.4					
			Bottom	16.7	30.3	7.34	7.48	90.4	89.5	2.25	3.52	3.6	4.1					
18/03/16	1428-1445	18/Cloudy	Surface	17.6	30.2	30.2	7.46	7.36	89.4	92.9	3.50	1.74	2.5	2.4	2.7			
			Middle	17.4	30.4	7.26	7.25	92.8	89.0	1.79	2.26	2.2	3.0					
			Bottom	17.4	30.2	7.24	7.27	93.0	91.7	1.68	2.29	2.2	2.8					

Mid-Flood Tide



專業檢測顧問有限公司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Middle		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Depth-average	Value
21/03/16	1702-1716	17/Cloudy	Surface	1.0	17.8	27.4	27.4	6.79	6.81	81.5	81.7	2.52	2.54	3.3	3.3	3.5	
						27.4	27.4	6.82	6.77	81.8	81.3	2.56	2.49	3.3	3.7		
						27.3	27.3	6.76	6.77	81.1	81.3	2.49	2.48	3.7	3.9		
23/03/16	1746-1801	18/Cloudy	Bottom	9.4	17.9	27.4	27.4	6.69	6.71	80.3	80.6	2.59	2.58	3.4	3.4	3.6	
						27.4	27.4	6.73	7.06	80.8	88.2	2.56	2.62	3.3	3.9		
						29.5	29.4	6.98	7.06	87.3	88.2	2.59	2.62	3.9	3.7		
23/03/16	1746-1801	18/Cloudy	Middle	5.2	17.9	29.8	29.7	6.89	6.92	83.9	84.3	2.16	2.25	2.8	3.1	3.6	
						29.5	29.5	6.95	6.92	84.7	84.3	2.33	2.25	3.3	2.8		
						30.1	29.9	7.07	7.05	88.4	88.2	2.87	2.95	3.7	3.7		
30/03/16	1010-1030	18/Cloudy	Bottom	9.3	17.9	29.6	29.9	7.03	7.05	87.9	88.2	3.02	2.95	3.9	3.8	3.6	
						30.0	30.0	7.02	7.06	88.1	88.5	2.84	2.90	4.0	3.9		
						29.9	29.9	7.09	7.06	88.9	88.5	2.95	2.90	3.8	3.8		
30/03/16	1010-1030	18/Cloudy	Surface	1.0	17.6	30.3	30.4	7.00	7.04	87.6	88.1	2.48	2.51	3.5	3.7	3.6	
						30.4	30.4	7.07	7.04	88.6	88.1	2.54	2.51	3.8	3.7		
						30.7	30.7	7.13	7.17	89.7	90.1	2.53	2.55	3.5	3.3		
			Bottom	9.2	17.5	30.6	30.7	7.20	7.17	90.5	90.1	2.56	2.55	3.1	3.3		

Mid-Ebb Tide



東業 德勤 測 試 顧 問 有 限 公 司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Value	Average
02/03/16	1800-1810	15/Cloudy	Surface	15.3	28.3	28.3	7.07	7.06	7.04	83.9	83.8	2.20	2.22	3.1	3.3	3.4		
			Middle	15.2	28.4	28.3	7.05	7.01	7.04	83.6	83.0	2.24	2.30	3.4	3.3			
			Bottom	15.0	28.6	28.6	7.02	6.90	6.90	82.8	81.6	2.29	2.49	3.5	3.7			
04/03/16	0805-0821	18/Fine	Surface	15.4	28.2	28.2	6.91	6.92	6.90	81.4	82.1	1.34	1.32	2.0	2.1	2.1		
			Middle	15.3	28.3	28.3	6.89	6.87	6.90	81.7	81.4	1.30	1.39	2.1	2.1			
			Bottom	15.0	28.6	28.6	6.88	6.81	6.81	81.2	80.5	1.41	1.66	2.1	2.3			
07/03/16	1030-1048	16/Cloudy	Surface	15.8	27.7	27.7	6.82	6.83	6.74	80.7	86.0	1.62	1.38	2.0	2.0	2.2		
			Middle	15.7	28.0	28.0	6.84	6.65	6.66	86.1	83.9	1.40	1.45	2.0	2.4			
			Bottom	15.6	28.2	28.2	6.64	6.51	6.51	83.7	81.9	1.47	1.72	2.3	2.4			
09/03/16	1130-1148	18/Cloudy	Surface	15.3	28.3	28.3	6.66	6.83	6.81	80.2	81.1	1.76	1.44	1.8	1.8	2.3		
			Middle	15.2	28.4	28.4	6.85	6.78	6.78	82.2	80.4	1.46	1.52	1.8	2.0			
			Bottom	14.9	28.7	28.7	6.79	6.72	6.72	80.6	79.5	1.53	1.78	2.0	2.2			
11/03/16	1300-1315	15/Cloudy	Surface	15.3	28.4	28.4	6.70	6.86	6.78	79.2	81.6	1.51	2.41	3.1	3.1	3.3		
			Middle	15.3	28.3	28.3	6.73	6.71	6.71	81.8	79.8	2.39	2.34	3.1	3.4			
			Bottom	15.3	28.4	28.4	6.87	6.50	6.50	80.0	77.3	2.36	2.45	3.7	3.5			
14/03/16	1500-1518	16/Cloudy	Surface	17.3	27.9	27.9	6.51	7.94	7.92	77.1	97.3	2.47	1.90	2.9	3.1	3.2		
			Middle	17.3	28.0	28.0	6.48	7.90	7.92	97.3	96.9	1.91	2.06	3.3	2.7			
			Bottom	17.1	28.2	28.2	7.92	7.73	7.73	96.8	94.9	2.04	2.32	2.4	2.7			
16/03/16	1730-1748	16/Cloudy	Surface	17.2	30.3	30.3	7.71	7.52	7.55	95.0	94.9	2.30	2.21	2.8	2.9	3.9		
			Middle	17.1	30.5	30.5	7.74	7.58	7.55	95.1	93.8	2.14	2.63	2.8	4.0			
			Bottom	17.0	30.6	30.6	7.53	7.46	7.46	94.0	92.5	2.65	3.38	4.2	4.9			
18/03/16	0827-0837	18/Cloudy	Surface	17.7	30.4	30.4	7.44	7.06	7.08	92.4	89.1	3.34	1.98	2.6	2.7	3.1		
			Middle	17.4	30.3	30.3	7.48	7.09	7.08	88.9	86.6	1.97	2.12	2.8	3.3			
			Bottom	17.4	30.4	30.4	7.05	7.04	7.04	86.7	86.7	2.08	2.24	3.3	3.5			

Mid-Ebb Tide



東業德動測試顧問有限公司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)		Suspended Solids (mg/L)		
			Surface	Middle		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average
21/03/16	1030-1044	18/Cloudy	Surface	1.0	17.8	27.2	27.2	6.86	6.88	82.3	82.5	2.21	2.24	2.7	3.0	3.1	
						27.2	27.2	6.89	6.86	82.7	2.26	3.2					
						27.1	27.2	6.82	6.84	81.8	2.44	2.9					
23/03/16	1138-1153	18/Cloudy	Middle	9.4	17.7	27.2	27.2	6.85	6.84	82.2	82.0	2.48	2.46	3.0	3.0	3.1	
						27.3	27.3	6.72	6.75	80.6	2.51	3.5					
						27.2	27.3	6.77	6.75	80.5	2.48	3.2					
23/03/16	1138-1153	18/Cloudy	Bottom	17.8	17.7	29.8	29.7	6.98	6.97	88.7	88.6	2.48	2.46	3.7	3.6	3.9	
						29.5	29.7	6.95	6.93	88.5	2.43	3.4					
						29.9	29.9	6.88	6.93	86.9	2.75	3.9					
30/03/16	1530-1548	18/Cloudy	Middle	8.6	17.9	29.8	29.9	6.97	6.93	87.8	87.4	2.98	2.87	4.2	4.1	3.9	
						29.6	29.7	7.02	6.99	88.5	2.75	3.9					
						29.8	29.7	6.95	6.99	87.5	2.91	4.4					
30/03/16	1530-1548	18/Cloudy	Bottom	16.2	18.1	29.1	29.2	6.87	6.91	86.2	86.8	2.44	2.38	3.4	3.2	3.9	
						29.2	29.2	6.95	6.91	87.3	2.31	3.0					
						29.4	29.5	6.79	6.81	85.5	3.01	3.9					
30/03/16	1530-1548	18/Cloudy	Surface	1.0	17.9	29.5	29.5	6.83	6.81	86.1	85.8	2.89	2.95	4.0	4.0	3.9	
						29.2	29.3	6.95	6.92	87.8	2.85	4.6					
						29.3	29.3	6.89	6.92	87.1	2.92	4.4					

Mid-Ebb Tide



東業 德 測 試 顧 問 有 限 公 司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value
02/03/16	1915-1930	15/Cloudy	Surface	1.0	15.4	28.2	28.2	6.97	6.96	82.9	82.7	2.16	2.18	2.8	3.0	3.2		
						28.1	6.95	82.5	2.20	3.1								
						28.2	6.92	82.1	2.21	2.9								
04/03/16	0919-0936	18/Fine	Surface	1.0	15.3	28.2	28.2	6.87	6.86	81.3	81.1	2.29	2.43	3.4	3.7	1.8		
						28.4	6.85	80.9	2.45	3.9								
						28.4	7.02	83.3	1.21	1.5								
07/03/16	1210-1230	16/Cloudy	Surface	1.0	15.6	27.7	27.8	6.60	6.61	83.2	83.3	1.27	1.24	1.8	1.8	1.9		
						27.8	6.61	83.4	1.21	1.9								
						27.9	6.53	82.2	1.29	1.8								
09/03/16	1310-1330	18/Cloudy	Surface	1.0	15.2	28.3	28.3	6.93	6.92	82.3	82.1	1.33	1.30	1.7	1.8	2.0		
						28.2	6.91	81.9	1.27	1.9								
						28.3	6.85	81.3	1.38	2.2								
11/03/16	1408-1424	15/Cloudy	Surface	1.0	15.4	28.4	28.4	6.79	6.80	80.8	80.9	2.38	2.36	3.6	3.7	3.5		
						28.4	6.81	81.0	2.34	3.7								
						28.4	6.62	78.8	2.46	3.2								
14/03/16	1642-1700	16/Cloudy	Surface	1.0	17.0	27.7	27.8	8.05	8.05	98.6	98.9	1.97	1.99	2.4	2.6	2.8		
						27.8	7.96	97.7	2.12	2.8								
						27.9	7.94	97.3	2.15	2.9								
16/03/16	1856-1914	16/Cloudy	Surface	1.0	16.8	30.1	30.2	7.44	7.44	91.4	91.4	1.95	1.99	2.3	2.5	3.1		
						30.2	7.43	91.3	2.03	2.6								
						30.2	7.50	92.9	2.26	3.2								
18/03/16	0939-0952	18/Cloudy	Surface	1.0	17.3	30.4	30.3	7.10	7.12	90.1	90.0	2.43	2.41	2.9	3.3	3.3		
						30.4	7.13	89.8	2.39	3.6								
						30.2	6.93	86.5	2.59	3.4								
			Bottom	8.9	17.4	30.2	30.5	7.07	7.08	88.0	87.8	2.16	2.18	3.0	3.1			
						30.2	7.09	87.5	2.20	3.1								
						30.7	7.08	88.0	2.20	3.1								

Mid-Ebb Tide



家業維勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-M4


Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen Saturation (%)		Turbidity (NTU)		Suspended Solids (mg/L)	
			Surface	Middle		Value	Average	Value	Average	Value	Average	Value	Depth-average	Value	Average
21/03/16	1131-1146	18/Cloudy	Surface	1.0	17.9	27.2	27.2	6.74	6.76	80.9	81.2	2.46	2.48	3.2	3.2
						27.2	27.2	6.78	6.75	81.4	2.49	3.2			
						27.1	27.1	6.72	6.73	80.6	2.52	3.5			
21/03/16	1131-1146	18/Cloudy	Middle	5.1	17.8	27.1	27.1	6.74	6.73	80.9	80.8	2.50	2.51	3.5	3.5
						27.1	27.1	6.74	6.73	80.9	2.50	3.5			
						27.1	27.1	6.69	6.71	80.3	2.62	3.2			
21/03/16	1131-1146	18/Cloudy	Bottom	9.2	17.8	27.1	27.1	6.72	6.71	80.6	80.5	2.63	2.63	3.9	3.6
						27.1	27.1	6.72	6.71	80.6	2.63	3.9			
						29.8	29.9	6.96	7.02	86.9	87.1	2.93	2.99	4.1	4.4
23/03/16	1258-1313	18/Cloudy	Surface	1.0	17.8	30.0	30.0	7.08	7.02	87.3	87.1	3.04	2.99	4.6	4.4
						30.4	30.5	6.96	6.99	87.2	87.9	2.57	2.61	3.9	3.8
						30.6	30.6	7.01	6.99	88.5	88.1	2.65	2.64	3.7	3.7
23/03/16	1258-1313	18/Cloudy	Middle	4.9	17.7	30.5	30.5	7.07	7.11	87.6	88.1	2.62	2.64	3.4	3.7
						30.5	30.8	7.14	7.11	88.5	88.1	2.65	2.64	4.0	3.7
						31.0	30.8	7.14	7.11	88.5	88.1	2.65	2.64	4.0	3.7
23/03/16	1258-1313	18/Cloudy	Bottom	8.8	17.7	29.2	29.3	6.89	6.92	86.7	87.1	2.71	2.68	3.4	3.8
						29.3	29.3	6.94	6.92	87.4	87.1	2.71	2.68	4.1	3.8
						29.6	29.6	6.80	6.83	85.4	85.8	2.30	2.35	3.2	3.2
30/03/16	1710-1730	18/Cloudy	Middle	4.9	17.8	29.5	29.6	6.86	6.83	86.2	85.8	2.39	2.35	3.1	3.2
						29.5	29.6	6.86	6.83	86.2	85.8	2.39	2.35	3.1	3.2
						29.9	30.0	6.98	6.96	87.7	87.5	2.93	2.95	4.4	4.0
30/03/16	1710-1730	18/Cloudy	Bottom	8.7	17.7	30.0	30.0	6.94	6.96	87.2	87.5	2.96	2.95	3.6	4.0
						30.0	30.0	6.94	6.96	87.2	87.5	2.96	2.95	3.6	4.0
						30.0	30.0	6.94	6.96	87.2	87.5	2.96	2.95	3.6	4.0




Appendix I

D3


Graphical Plots of Impact Marine Water Quality Monitoring Data




Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

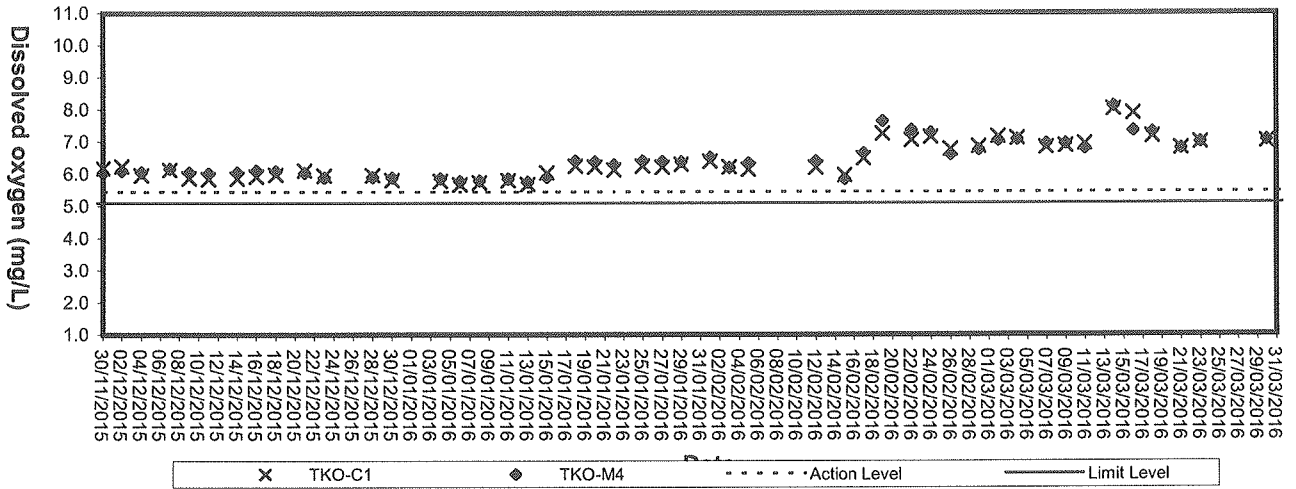


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

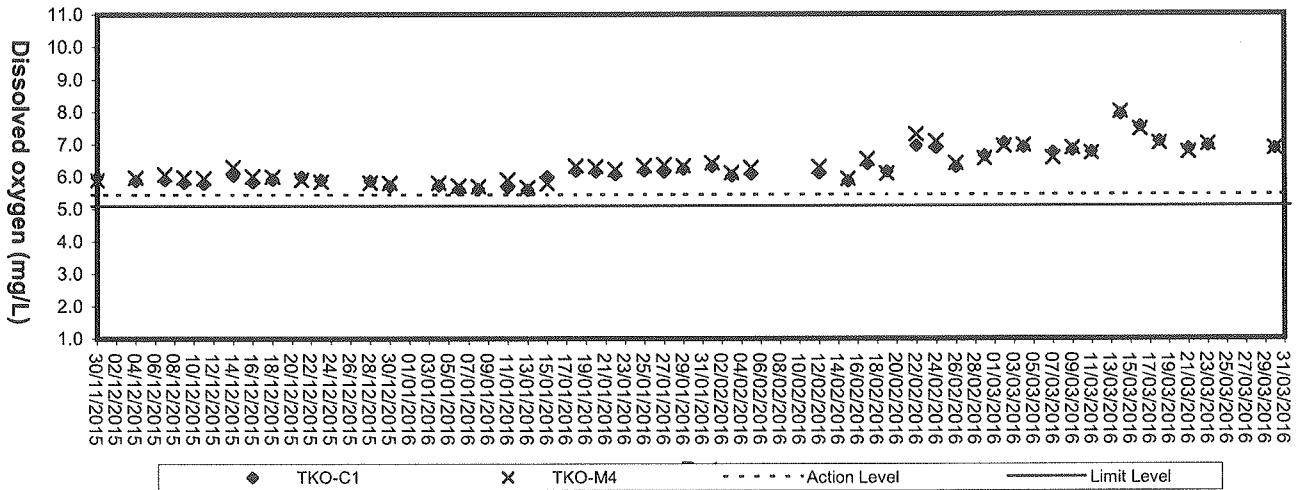





Dissolved Oxygen (Bottom) at Mid-Flood Tide

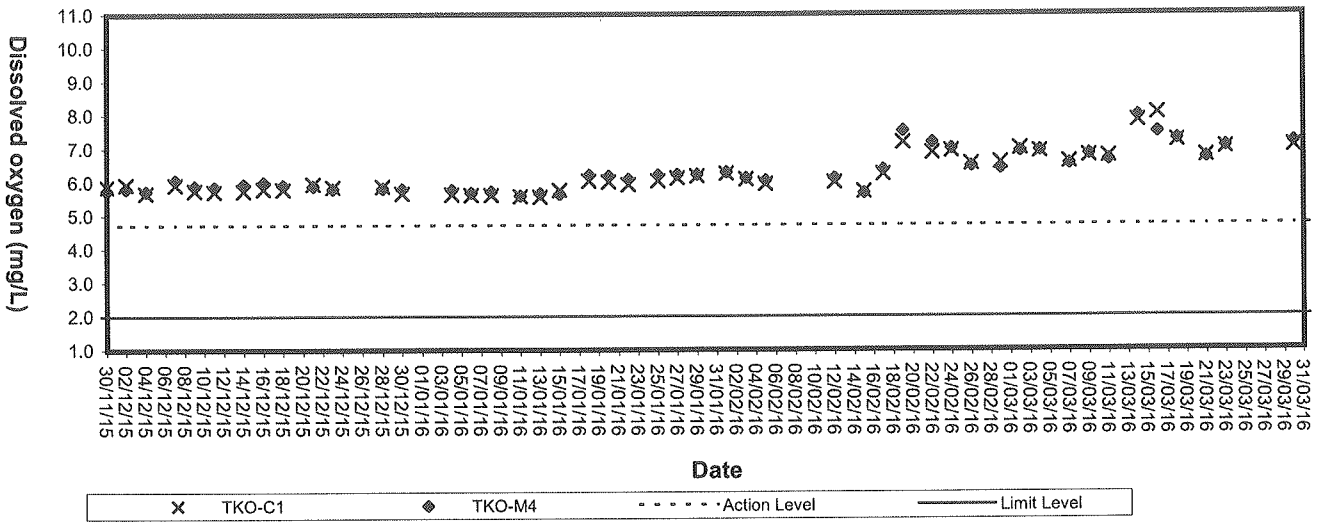


Dissolved Oxygen (Bottom) at Mid-Ebb Tide

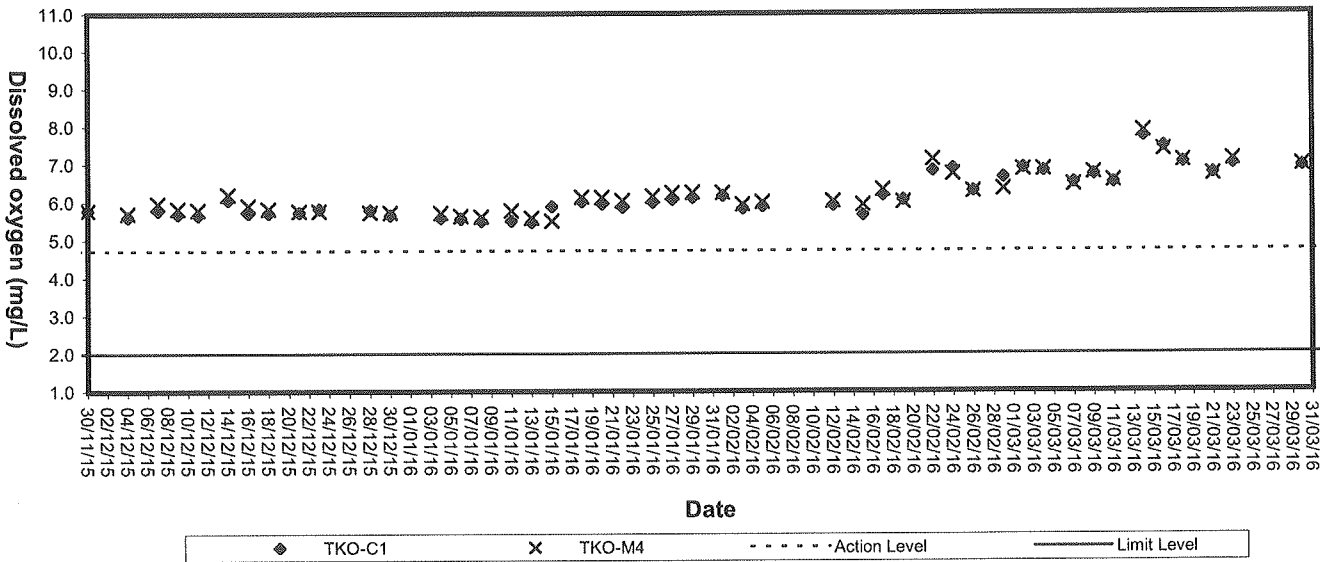





Turbidity (Depth-average) at Mid-Flood Tide

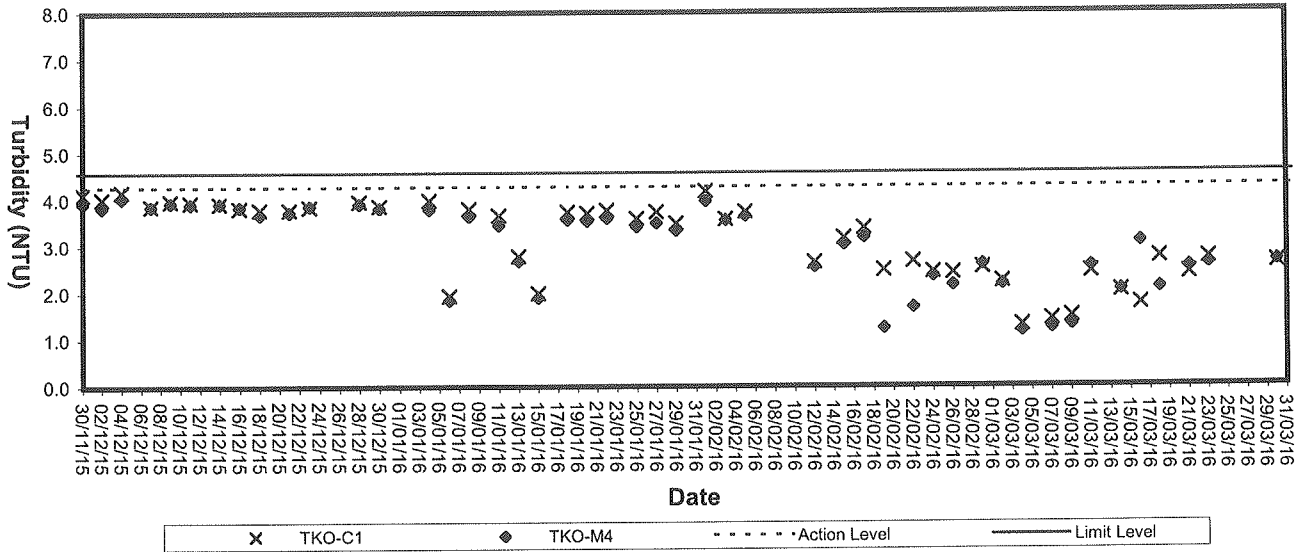


Turbidity (Depth-average) at Mid-Ebb Tide

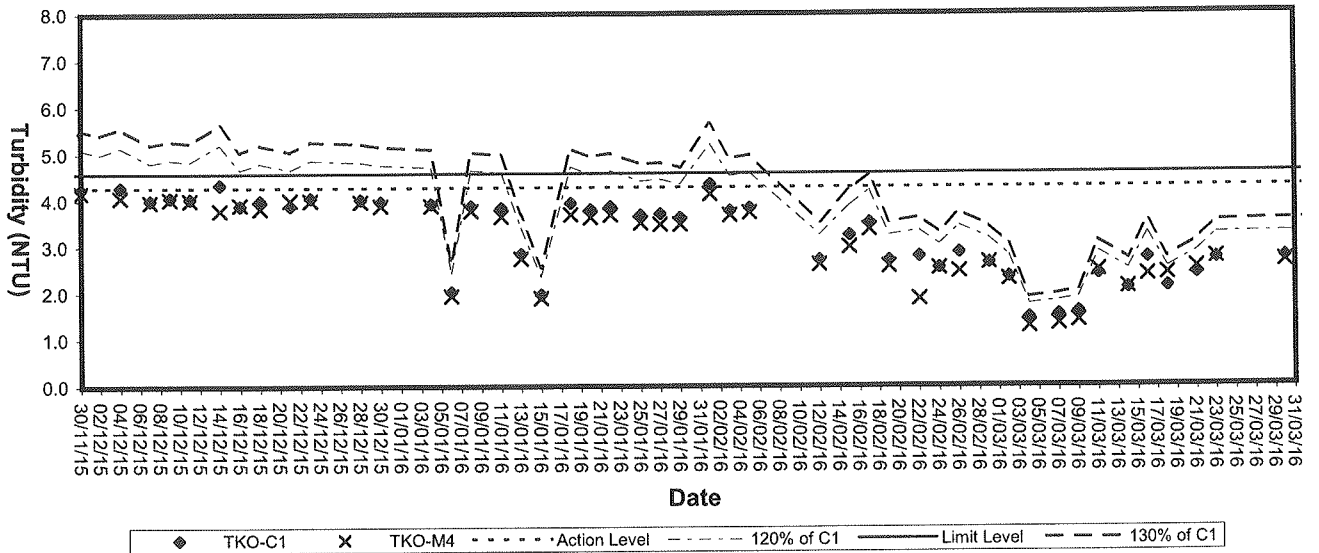




Suspended solids (Depth-average) at Mid-Flood Tide

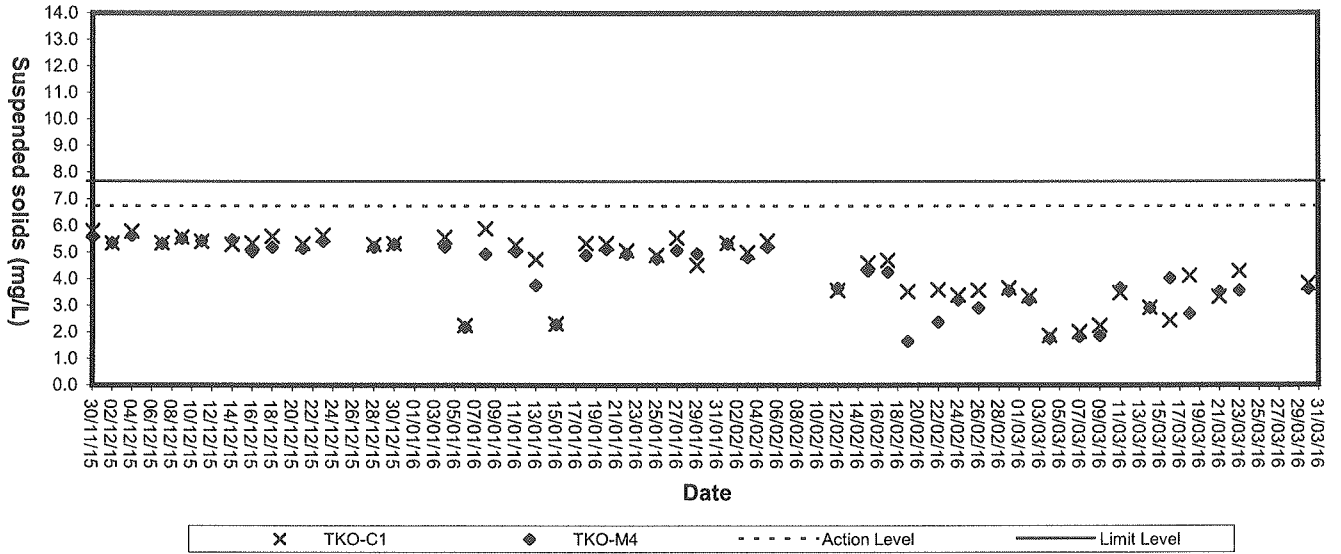

Suspended Solids (Depth-average) at Mid-Ebb Tide

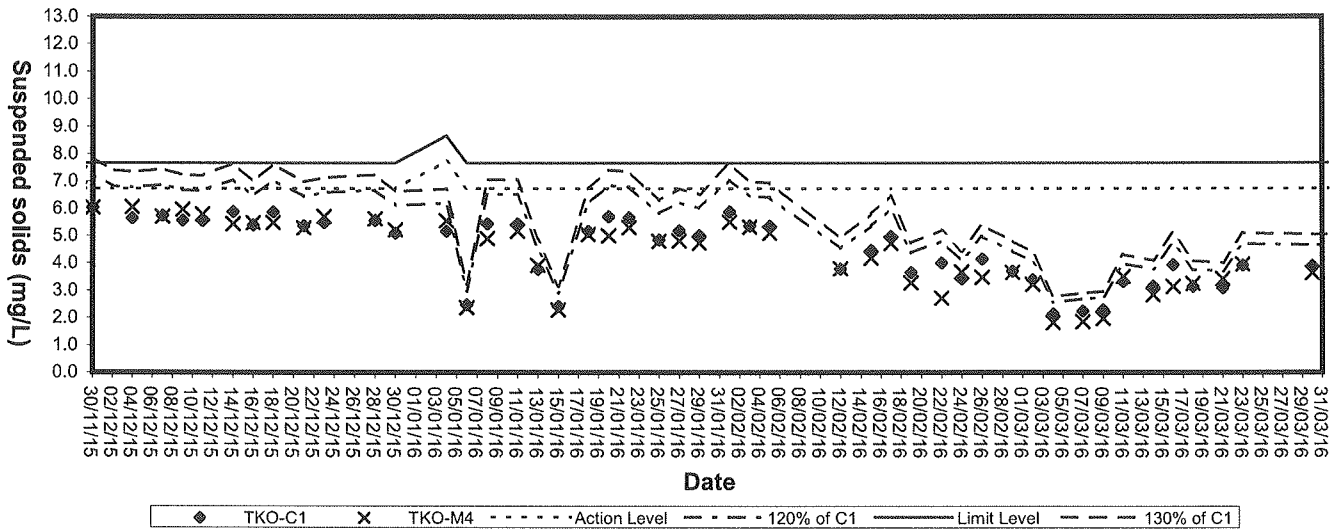



Appendix I

E

Weather Condition

Daily Extract of Meteorological Observations, March 2016 – Tseung Kwan O

Day	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)					
01	***	19.1	15.5	13.4	10.3	73	0.0	350	8.4
02	***	19.3	15.3	12.9	10.1	73	0.0	350	7.3
03	***	23.7	17.1	12.5	12.2	76	0.0	360	4.0
04	***	24.1	19.1	15.6	16.0	83	0.0	360	4.3
05	***	23.4	19.8	17.0	16.0	79	0.0	360	3.7
06	***	26.5	20.8	16.6	17.1	81	0.0	360	3.3
07	***	19.7	17.9	16.8	17.4	97	1.0	360	4.1
08	***	20.6	18.8	17.8	18.2	97	0.0	360	3.4
09	***	21.4	19.6	16.1	19.3	98	15.0	360	3.8
10	***	16.1	12.1	9.0	10.9	93	18.0	350	7.9
11	***	13.8	10.9#	9.0	7.0#	77#	0.0#	350#	6.4#
12	***	13.7	13.2#	12.4	12.2#	94#	1.5#	350#	7.6#
13	***	16.4	15.3	13.6	15.1	99	8.5	350	4.8
14	***	16.4	14.5	12.7	11.9	85	0.5	350	6.6
15	***	15.1	14.1	13.1	10.5	80	0.0	350	7.5
16	***	15.7	14.8	13.3	13.3	91	4.0	350	6.6
17	***	16.7	15.9	15.2	15.8	99	8.0	350	4.8
18	***	21.1	18.7	16.5	18.5	99	0.5	360	2.5
19	***	23.9	21.4	19.5	21.0	97	0.0	360	3.2
20	***	21.6	17.8	16.4	16.9	94	1.5	350	7.5
21	***	17.5	16.4	15.7	15.9	97	65.0	350	7.7
22	***	16.5	15.9	15.3	15.7	99	5.0	350	6.7
23	***	19.9	17.6	16.4	17.5	99	10.0	360	4.4
24	***	16.8	14.6	11.9	14.1	97	38.5	350	6.6
25	***	15.3	12.2	9.5	9.5	85	1.5	350	4.9
26	***	19.8	13.6	8.5	9.2	77	0.0	360	4.5
27	***	21.8	14.9#	10.4	6.5#	64#	0.0#	350#	7.1#
28	***	***	***	***	***	***	***	***	***
29	***	19.1	17.3#	16.3	9.8#	63#	0.0#	360#	4.2#
30	***	21.4	19.1	16.6	15.6	80	0.0	360	3.5
31	***	24.9	20.4	17.0	18.4	89	0.0	360	2.8

*** unavailable

data incomplete

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected



Appendix I

F

Event-Action Plans

EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ET Leader	ACTION LEVEL IC(E)	ACTION ER	Contractor
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures 2. Inform ER, IC(E) and Contractor 3. Repeat measurement to confirm finding 4. Increase monitoring frequency to daily 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by the ET 2. Check contractor's working method 	<ol style="list-style-type: none"> 1. Notify Contractor 	<ol style="list-style-type: none"> 1. Rectify any unacceptable practise 2. Amend working methods if appropriate
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures 2. Inform IC(E) and Contractor 3. Repeat measurements to confirm finding 4. Increase monitoring frequency to daily 5. Discuss with IC(E) and Contractor on remedial actions 6. If exceedance continues, arrange meeting with IC(E) and ER. 7. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by the ET 2. Check the Contractor's working method 3. Discuss with ET and Contractor on possible remedial measures 4. Advise the ER on the effectiveness of the proposed remedial measures 5. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify the Contractor 3. Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> 1. Submit proposals for remedial actions to IC(E) within 3 working days of notification 2. Implement the agreed proposals 3. Amend proposal if appropriate
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures 2. Inform ER, Contractor and EPD 3. Repeat measurement to confirm finding 4. Increase monitoring frequency to daily 5. Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results 	<p style="text-align: center;">LIMIT LEVEL</p> <ol style="list-style-type: none"> 1. Check monitoring data submitted by the ET 2. Check Contractor's working method 3. Discuss with ET and Contractor on possible remedial measures 4. Advise the ER on the effectiveness of the proposed remedial measures 5. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify the Contractor 3. Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification 3. Implement the agreed proposals 4. Amend proposal if appropriate.

EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ACTION			Contractor
	ET Leader	IC(E)	ER	
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures 2. Notify IC(E), ER, EPD and Contractor 3. Repeat measurement to confirm finding 4. Increase monitoring frequency to daily 5. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented 6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken 7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results 8. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET and Contractor on the potential remedial actions 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly 3. Supervise the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. In consultation with the IC(E), agree with the Contractor on the remedial measures to be implemented 4. Ensure remedial measures are properly implemented 5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedances 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant activity of works as determined by the ER until the exceedance is abated

EVENT/ACTION PLAN FOR NOISE EXCEEDANCE

EVENT	ACTION			
	ET Leader	IC(E)	ER	Contractor
Action Level	<ol style="list-style-type: none"> 1. Notify the IC(E) and the Contractor. 2. Carry out investigation. 3. Report the results of investigation to the IC(E) and the Contractor. 4. Discuss with the Contractor and formulate remedial measures. 5. Increase monitoring frequency to check mitigation effectiveness 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET. 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly. 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analysed noise problem. 4. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IC(E). 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Notify the IC(E), the ER, the EPD and the Contractor. 2. Identify source. 3. Repeat measurement to confirm findings. 4. Increase monitoring frequency. 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. 6. Inform the IC(E), the ER and the EPD the causes & actions taken for the exceedances. 7. Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results 8. If exceedance due to the construction works stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions. 2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly. 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analysed noise problem. 4. Ensure remedial measures are properly implemented. 5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification. 3. Implement the agreed proposals. 4. Resubmit proposals if problem still not under control. 5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
<p>Action level being exceeded by one sampling day</p>	<ol style="list-style-type: none"> 1. Identify source(s) of impact; 2. Repeat in-situ measurement to confirm findings; 3. Notify Contractor in writing within 24 hours of identification of the exceedance 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days 8. Repeat measurement on next day of exceedance if exceedance is due to the construction works 	<ol style="list-style-type: none"> 1. Notify the ER and IEC in writing within 24 hours of identification of exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance 5. Consider changes of working method if exceedance is due to the construction works 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Require contractor to propose remedial measures for the analysed problem if related to the construction works 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the mitigation measure 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures 4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly 5. Supervise the implementation of mitigation measures

EVENT AND ACTION PLAN FOR WATER QUALITY

Event	ACTION			IEC
	ET Leader	Contractor	ER	
<p>Action level being exceeded by more than one consecutive sampling days</p>	<ol style="list-style-type: none"> 1. Identify source(s) of impact; 2. Repeat in-situ measurement to confirm findings 3. Notify Contractor in writing within 24 hours of identification 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance 8. Ensure mitigation measures are implemented; 9. Prepare to increase the monitoring frequency to daily; 10. Repeat measurement on next day of exceedance. 	<ol style="list-style-type: none"> 1. Notify IEC and ER in writing within 24 hours of identification of exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Require contractor to propose remedial measures for the analysed problem if related to the construction works 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the mitigation measure 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures. 4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly 5. Assess the effectiveness of the implemented mitigation measures.

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> 1. Repeat in-situ measurement to confirm findings; identify source(s) of impact; 2. Notify Contractor in writing within 24 hours of identification of the exceedance 3. Check monitoring data, all plant, equipment and Contractor's working methods; 4. Carry out investigation 5. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 6. Discuss mitigation measures with IEC, ER and Contractor within 4 working of identification of an exceedance 7. Ensure mitigation measures are implemented; 8. Increase the monitoring frequency to daily until no exceedance of Limit Level. 	<ol style="list-style-type: none"> 1. Notify IEC and ER in writing; within 24 hours of the identification of the exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Request Contractor to critically review the working methods; 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the implemented mitigation measures. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures. 4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly. 5. Assess the effectiveness of the implemented mitigation measures

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
<p>Limit Level being exceeded by more than one consecutive sampling days</p>	<ol style="list-style-type: none"> 1. Repeat in-situ measurement to confirm findings; 2. Identify source(s) of impact; 3. Notify Contractor in writing within 24 hours of identification of the exceedance 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with IEC, ER and Contractor; 8. Ensure mitigation measures are implemented; 9. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days. 	<ol style="list-style-type: none"> 1. Notify ER and IEC in writing within 24 hours of the identification of the exceedance and Rectify unacceptable practice; 2. Check all plant and equipment; 3. Consider changes of working methods; 8. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance 5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days; 6. Implement the agreed mitigation measures within reasonable time scale 7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities. 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Request Contractor to critically review the working methods; 6. Ensure remedial measures are properly implemented 4. Assess the effectiveness of the implemented mitigation measures; 5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ER, ET and Contractor on the mitigation measures. 4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly. 5. Assess the effectiveness of the implemented mitigation measures.



Appendix I

G

Works Programme

Master Programme of Contract No. CV/2013/06 - Handling of Surplus Public Fill

Site Location : Tseung Kwan O Area 137 Fill Bank

ID	Activity	Original Duration	Start	Finish
A1150	Take Over	0	23-Jan-14	
A1170	Operation	1100	23-Jan-14	26-Jan-17
A1370	Hand Over to CEDD	0		26-Jan-17
Stage A1 Construction of New Office		120	28-Nov-13	27-May-14
A1080	Submission	30	28-Nov-13	27-Dec-13
A1090	Approval by Engineer	7	28-Dec-13	03-Jan-14
A1100	Installation	64	23-Jan-14	27-May-14
A1110	Hand Over to Engineer	0		27-May-14
Stage A1 Surveillance System		120	28-Nov-13	27-May-14
A1190	Submission	30	28-Nov-13	27-Dec-13
A1200	Approval by Engineer	7	28-Dec-13	03-Jan-14
A1210	Installation	64	23-Jan-14	27-May-14
A1230	Hand Over to Engineer	0		27-May-14



Appendix I

H




Weekly ET's Site Inspection Record



CEDD Contract No.: CV/2013/06

Handing of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 2/3/16
Time : 10:00
Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
Wind : Calm / Light / Breeze / Strong
Temperature : 18°C
Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	HON CHUNG LUN	Eric Wan	Mak Kei Wan
Title	ALOW / P3 C1	EO	E.T

Implementation Stages*	Remark	
	Yes	No / N/A
Environmental Checklist		
Fugitive Dust Emission		
✓		Dust control / mitigation measures shall be provided to prevent dust nuisance.
✓		A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.
✓		Water sprays shall be provided and used to dampen materials.
✓		Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.
✓		All vehicles shall be restrict to a maximum speed of 10 km per hour.
✓		Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.
✓		The designated site main haul road shall be paved or regular watering.
✓		Frequent watering of work site shall be at least three times per day.
✓		Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.
✓		Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.
✓		All plant and equipment should be well maintained e.g. without black smoke emission.
✓		Open burning should be prohibited.
✓		The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.
✓		Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.
✓		When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.
✓		The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.
✓		The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.
✓		Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).
Noise Impact		
✓		The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.
✓		Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.
✓		Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.
✓		Air compressors and hand held breakers should have noise labels.
✓		Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.
✓		Noisy equipment and mobile plant shall always be site away from NSRs.

	Implementation Stages*		Remark
	Yes	No / N/A	
Water Quality			
▪ Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓		Item 1
▪ The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	✓		
▪ Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓		
▪ Manholes should be covered and sealed.	✓		
▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓		
▪ A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓		
▪ A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	✓		
▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓		
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓		
▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓		
▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓		
▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓		
▪ Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓		
▪ Oil interceptor shall be provided at work shop.	✓		
▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓		
▪ The barges shall be in tight size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓		
▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓		
▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓		
▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓		
▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓		
▪ Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓		
▪ A waste collection vessel shall be deployed to remove floating debris.	✓		

		Implementation Stages*		Remark
		Yes	No	
Environmental Checklist				
Landscape and Visual				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√		
Other Environmental Factors				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√		
▪	All generators, fuel and oil storage are within bundle areas.	√		
▪	Oil leakage from machinery, vehicle and plant is prevented.	√		
▪	The Environmental Permit should be displaced conspicuously on site.	√		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√		



Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Debris of dead leaves were accumulated inside the u-channel near site entrance.	To clear the accumulated leaves in order to avoid any blockage.	160302_001	Yes	09/03/16

Remark

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		02 March 2016

Photos



Photo 160302_001 (U-channel near site entrance)



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 9.3.16

Time : 9:30

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 17C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
TS	EC	ES	
Name:	CHAN OI WAI	Eric Wain	Tyngky
Title	102/93	EO	ET



Environmental Checklist		Implementation Stages*			Remark
		Yes	No	N/A	
Fugitive Dust Emission					
▪	Dust control / mitigation measures shall be provided to prevent dust nuisance.	✓			
▪	A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	✓			
▪	Water sprays shall be provided and used to dampen materials.	✓			
▪	Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	✓			
▪	All vehicles shall be restrict to a maximum speed of 10 km per hour.	✓			
▪	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	✓			
▪	The designated site main haul road shall be paved or regular watering.	✓			
▪	Frequent watering of work site shall be at least three times per day.	✓			
▪	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	✓			
▪	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	✓			
▪	All plant and equipment should be well maintained e.g. without black smoke emission.	✓			
▪	Open burning should be prohibited.	✓			
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓			
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓			
▪	When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	✓			
▪	The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	✓			
▪	The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	✓			
▪	Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	✓			
Noise Impact					
▪	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	✓			
▪	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	✓			
▪	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	✓			
▪	Air compressors and hand held breakers should have noise labels.	✓			
▪	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	✓			
▪	Noisy equipment and mobile plant shall always be site away from NSRs.	✓			

	Implementation Stages*	Remark
Water Quality		
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√	Item 1
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√	
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√	
Manholes should be covered and sealed.	√	
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√	Item 2
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√	
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√	
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√	
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√	
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√	
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√	
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√	
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√	
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√	
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√	
Oil interceptor shall be provided at work shop.	√	
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√	
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√	
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√	
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√	
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√	
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√	
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√	
A waste collection vessel shall be deployed to remove floating debris.	√	

		Implementation Stages*			Remark
		Yes	No	N/A	
Environmental Checklist					
Landscape and Visual					
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√			
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√			
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√			
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√			
Other Environmental Factors					
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√			
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√			
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√			
▪	All generators, fuel and oil storage are within bundle areas.	√			
▪	Oil leakage from machinery, vehicle and plant is prevented.	√			
▪	The Environmental Permit should be displaced conspicuously on site.	√			
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√			
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√			



Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up the action to item 1 on 02/03/2016, Debris of dead leaves were still accumulated inside the u-channel near site entrance. <i>debris</i>	To clear the accumulated leaves in order to avoid any blockage.	160309_001	Yes	09/03/16 <i>16</i>
2	Stagnant Water was observed on the ground near work shop. <i>Water</i>	To remove the stagnant water as soon as possible.	160309_002	Yes	16/03/16

Remark

--

Name	Title	Signature	Date
Prepared by Frankie Tang	Assistant Supervisor	<i>[Signature]</i>	09 March 2016
Checked by Linda Law	Senior Environmental Officer	<i>[Signature]</i>	09 March 2016




Photos



Photo 160309_001 (U-channel near site entrance)



Photo 160309_002 (Near work shop)

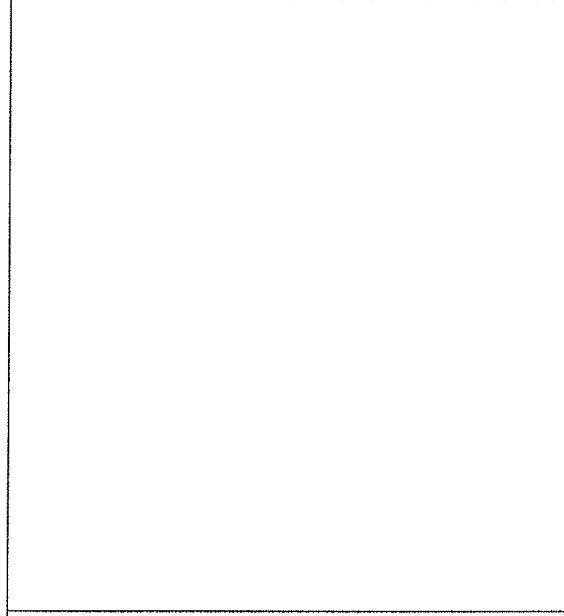



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 16/3/16


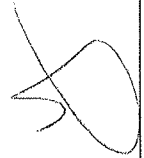

Time : 10:30

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 16°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN OI WAI	Eric Wan	Mark Lee Tshai
Title	IEW/P3	EO	E.T



	Implementation Stages*			Remark
	Yes	No	N/A	
Environmental Checklist				
Fugitive Dust Emission				
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.	√			
▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	√			
▪ Water sprays shall be provided and used to dampen materials.	√			
▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	√			
▪ All vehicles shall be restrict to a maximum speed of 10 km per hour.	√			
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	√			
▪ The designated site main haul road shall be paved or regular watering.	√			
▪ Frequent watering of work site shall be at least three times per day.	√			
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	√			
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√			
▪ All plant and equipment should be well maintained e.g. without black smoke emission.	√			
▪ Open burning should be prohibited.	√			
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√			
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√			
▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√			
▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt	√			
▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√			
▪ Approval or exemption Non-road Mobile Machinery (NRM/M) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	√			
Noise Impact				
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	√			
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	√			
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√			
▪ Air compressors and hand held breakers should have noise labels.	√			
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	√			
▪ Noisy equipment and mobile plant shall always be site away from NSRs.	√			

	Implementation Stages*		Remark
	Yes	No / N/A	
Water Quality			
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√		Item 3
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√		
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√		
Manholes should be covered and sealed.	√		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√		
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√		
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√		
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√		
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√		
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√		
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√		
Oil interceptor shall be provided at work shop.	√		
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√		
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√		
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√		
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√		
A waste collection vessel shall be deployed to remove floating debris.	√		




Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
Landscape and Visual				
<ul style="list-style-type: none"> ▪ The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided. ▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD. ▪ Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed. ▪ The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare. 	√			
Other Environmental Factors				
<ul style="list-style-type: none"> ▪ C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal. ▪ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste. ▪ Any unused materials or those with remaining functional capacity should be recycled and stored properly. ▪ All generators, fuel and oil storage are within bundle areas. ▪ Oil leakage from machinery, vehicle and plant is prevented. ▪ The Environmental Permit should be displaced conspicuously on site. ▪ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment. ▪ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce. 	√			

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up the action to item 1 on 02/03/2016 and item 1 on 09/03/16, debris of dead leaves accumulated inside the u-channel near site entrance were cleared.	--	160316_001	No	--
2	Follow up the action to item 2 on 09/03/16, stagnant water observed on the ground near work shop was cleared.	--	160316_002	No	--
	Mud and silt were noted accumulated inside the u-channel near wheel washing bay.	To clear the accumulated mud and silt in order to avoid any blockage.	160316_003	Yes	23/03/16

Remark

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		16 March 2016

Photos

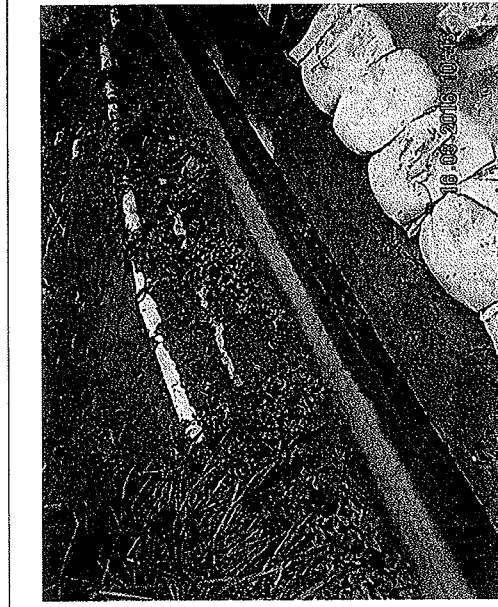


Photo 160316_001 (U-channel near site entrance) (Improved)

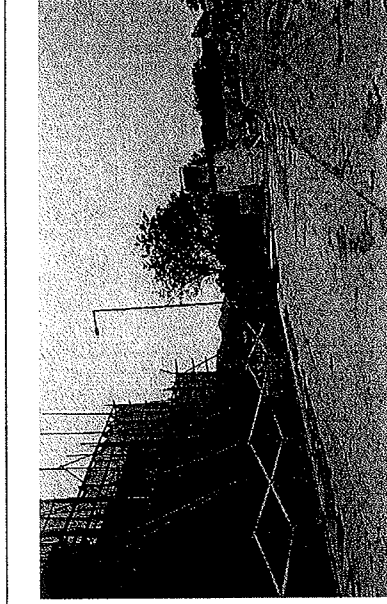


Photo 160316_002 (Near work shop) (Improved)

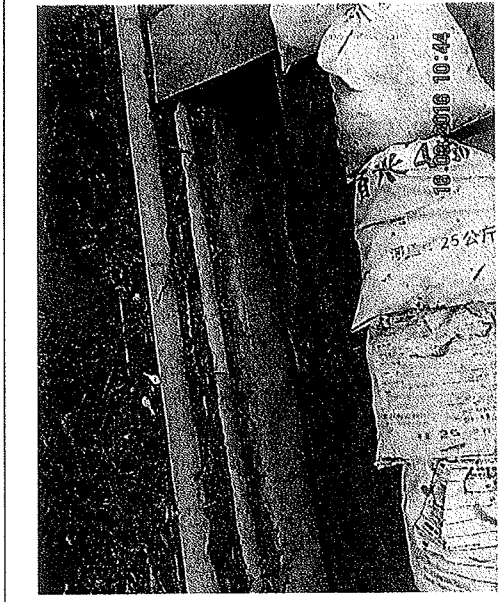


Photo 160316_003 (U-channel near wheel washing bay)

CEDD Contract No.: CV2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank



英泰测试咨询有限公司
ETS-TESTCONSULT LIMITED

Inspection Date : 22/3/16


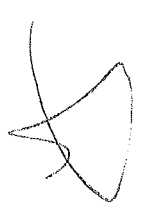

Time : 15:30

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 17°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN Oi Wo	Eric Wan	Mark Sei Wan
Title	LOW / PS	EO	E.T



	Implementation Stages*			Remark
	Yes	No	N/A	
Environmental Checklist				
Fugitive Dust Emission				
▪ Dust control / mitigation measures shall be provided to prevent dust nuisance.	√			
▪ A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	√			
▪ Water sprays shall be provided and used to dampen materials.	√			
▪ Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	√			
▪ All vehicles shall be restrict to a maximum speed of 10 km per hour.	√			
▪ Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	√			
▪ The designated site main haul road shall be paved or regular watering.	√			
▪ Frequent watering of work site shall be at least three times per day.	√			
▪ Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	√			
▪ Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√			
▪ All plant and equipment should be well maintained e.g. without black smoke emission.	√			
▪ Open burning should be prohibited.	√			
▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√			
▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√			
▪ When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√			
▪ The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	√			
▪ The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√			
▪ Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	√			
Noise Impact				
▪ The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	√			
▪ Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	√			
▪ Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√			
▪ Air compressors and hand held breakers should have noise labels.	√			
▪ Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	√			
▪ Noisy equipment and mobile plant shall always be site away from NSRs.	√			

		Implementation Stages*		Remark
		Yes	No / N/A	
Water Quality				
▪	Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓		Item 2
▪	The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	✓		
▪	Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓		
▪	Manholes should be covered and sealed.	✓		
▪	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓		
▪	A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓		
▪	A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	✓		
▪	The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓		
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
▪	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓		
▪	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓		
▪	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓		
▪	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓		
▪	Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓		
▪	Oil interceptor shall be provided at work shop.	✓		
▪	Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓		
▪	The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓		
▪	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓		
▪	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓		
▪	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓		
▪	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓		
▪	Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓		
▪	A waste collection vessel shall be deployed to remove floating debris.	✓		



	Implementation Stages*			Remark
	Yes	No	N/A	
Environmental Checklist				
Landscape and Visual				
▪ The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√			
▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√			
▪ Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√			
▪ The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√			
Other Environmental Factors				
▪ C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√			
▪ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√			
▪ Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√			
▪ All generators, fuel and oil storage are within bundle areas.	√			
▪ Oil leakage from machinery, vehicle and plant is prevented.	√			
▪ The Environmental Permit should be displaced conspicuously on site.	√			
▪ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√			
▪ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√			

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up the action to item 3 on 16/03/2016, mud and silt accumulated inside the u-channel near wheel washing bay were cleared.	--	160322_001	No	--
2	Mud and silt were noted accumulated inside CP5.	To clear the accumulated mud and silt in order to avoid any blockage.	160322_002	Yes	30/03/16

Remark

--

Name	Title	Signature	Date
Checked by Linda Law	Senior Environmental Officer		22 March 2016

Photos

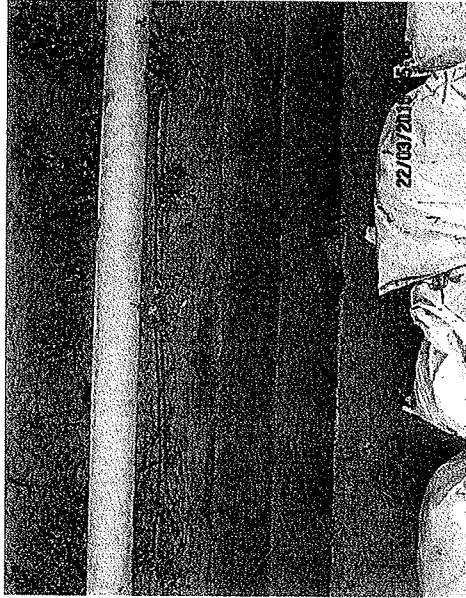


Photo 160316_001 (U-channel near wheel washing bay) (Improved)



Photo 160316_002 (CP5)



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 30.3.16
 Time : 10:00
 Weather : Sunny / ~~Fire~~ / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
 Wind : Calm / ~~Light~~ / Breeze / Strong
 Temperature : 17°C
 Humidity : High / ~~Moderate~~ / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	CHAN oi Wo	Eric Wan	Ting Chyngky
Title	102/93	EO	E.T



Environmental Checklist		Implementation Stages*			Remark
		Yes	No	N/A	
Fugitive Dust Emission					
▪	Dust control / mitigation measures shall be provided to prevent dust nuisance.	√			
▪	A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	√			
▪	Water sprays shall be provided and used to dampen materials.	√			
▪	Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	√			
▪	All vehicles shall be restrict to a maximum speed of 10 km per hour.	√			
▪	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	√			
▪	The designated site main haul road shall be paved or regular watering.	√			
▪	Frequent watering of work site shall be at least three times per day.	√			
▪	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	√			
▪	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√			
▪	All plant and equipment should be well maintained e.g. without black smoke emission.	√			
▪	Open burning should be prohibited.	√			
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√			
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√			
▪	When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√			
▪	The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	√			
▪	The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√			
▪	Approval or exemption Non-road Mobile Machinery (NRM/M) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	√			
Noise Impact					
▪	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	√			
▪	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	√			
▪	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√			
▪	Air compressors and hand held breakers should have noise labels.	√			
▪	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	√			
▪	Noisy equipment and mobile plant shall always be site away from NSRs.	√			

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

	Implementation Stages*		Remark
	Yes	No	
	N/A		
Water Quality			
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓		
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	✓		
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓		
Manholes should be covered and sealed.	✓		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓		
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓		
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront	✓		
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓		
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓		
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓		
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓		
Oil interceptor shall be provided at work shop.	✓		
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓		
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓		
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓	Item2	
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓		
A waste collection vessel shall be deployed to remove floating debris.	✓		

Environmental Checklist		Implementation Stages*			Remark
		Yes	No	N/A	
Landscape and Visual					
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√			
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√			
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√			
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√			
Other Environmental Factors					
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√			
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√			
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√			
▪	All generators, fuel and oil storage are within bundle areas.	√			
▪	Oil leakage from machinery, vehicle and plant is prevented.	√			
▪	The Environmental Permit should be displaced conspicuously on site.	√			
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√			
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√			



Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up the action to item 2 on 22/03/2016, mud and silt accumulated inside the CP5 were cleared.	---	160330_001	No	---
2	Mud was found accumulated on the concrete pavement along the barge handling area (BHA).	To clear the accumulated mud properly and provide the barrier to prevent fill material dropping to the sea.	160330_002	Yes	06/04/16

Remark

--

Name	Title	Signature	Date
Prepared by Frankie Tang	Assistant Supervisor		30 March 2016
Checked by Linda Law	Senior Environmental Officer		30 March 2016



Photos

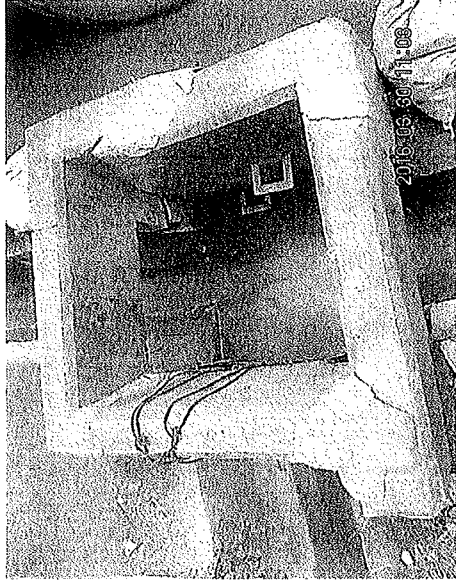


Photo 160330_001 (CP5)(Improved)

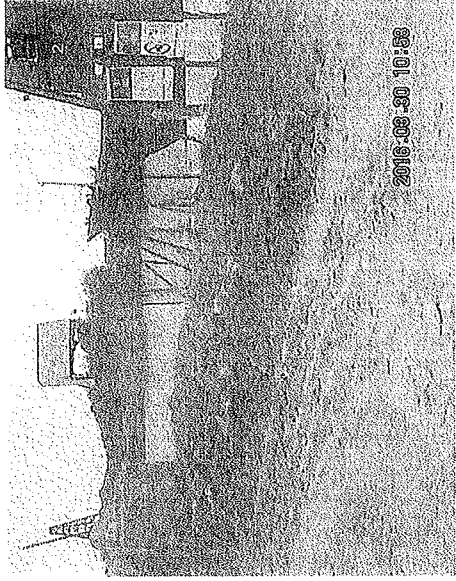


Photo 160330_002(BHA)




Appendix I

I

Implementation Schedule of Mitigation Measures



	Location	Implementation Status		
		Implemented	Partially implemented	Not implemented
Water Quality				
<ul style="list-style-type: none"> ▪ Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms. ▪ The permanent drainage channels should have sediment basin, traps and baffles and maintain properly. ▪ Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels. ▪ Manholes should be covered and sealed. ▪ Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding. ▪ A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front. ▪ A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront. ▪ The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge. ▪ The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD. ▪ Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD. ▪ Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. ▪ A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains. ▪ The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains. ▪ Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities. ▪ Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas and work shop. ▪ Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water. ▪ The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash. ▪ All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport. ▪ Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer. ▪ Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal. ▪ The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities. ▪ Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse. ▪ A waste collection vessel shall be deployed to remove floating debris. 	All areas	✓		
	All areas	✓		
	All areas	✓		
	All areas	✓		
	All areas	✓		
	Public fill stockpiling area	✓		
	C&DMFS	✓		
	All areas	✓		
	Temporary Slopes	✓		
	Temporary Slopes	✓		
	All areas	✓		
	Wheel Washing facility	✓		
	Wheel Washing facility	✓		
	All areas	✓		
	All areas	✓		
	Barge Handling Area (BHA)	✓		
	Barge Handling Area (BHA)	✓		
	Barge Handling Area (BHA)	✓		
	Along the seafront	✓		
	Barge Handling Area (BHA)	✓		
	Along the seafront	✓		
	Along the seafront	✓		
	Along the seafront	✓		



Appendix I

J

Site General Layout plan

NOTES:

1. ALL COORDINATES REFER TO HONG KONG 1980 DATUM UNITS IN METERS.
2. DIMENSIONS ARE IN METERS.
3. ALL DIMENSIONS ARE IN METERS.
4. EXISTING BRIDGE HANDLING AREAS PAVED SURFACING ARE TO BE MAINTAINED WITH SURFACING REFER TO DRAWING NO. 10114.
5. REFER TO DRAWING NO. 10106-1-4.
6. EXISTING BRIDGE HANDLING AREAS PAVED SURFACING ARE TO BE MAINTAINED WITH SURFACING REFER TO DRAWING NO. 10114.
7. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE RELEVANT AUTHORITIES.
8. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE RELEVANT AUTHORITIES.
9. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE RELEVANT AUTHORITIES.
10. THE CONTRACTOR SHALL BE RESPONSIBLE FOR OBTAINING ALL NECESSARY PERMITS AND APPROVALS FROM THE RELEVANT AUTHORITIES.

LEGEND:

- SITE BOUNDARY
- ▨ EXISTING BRIDGE HANDLING AREA
- EXISTING NAVIGATION LIGHT
- ⊗ BUFFER ZONE
- EXISTING CONCRETE ACCESS ROAD
- EXISTING FENCING
- PROPOSED IMPROVED FENCING
- ⊗ EXISTING WEIGHING POINT WITH 4 WEIGHBRIDGES

ABBREVIATIONS:

- M.S.B. WHEEL WASHING BAY
- M.S.F. WHEEL WASHING FACILITY


NO.	DATE	DESCRIPTION	PREPARED	CHECKED	APPROVED
DESIGNED	P. Y. LU	SIGNED	P. Y. LU	SIGNED	P. Y. LU
DRAWN	P. K. TU	SIGNED	P. K. TU	SIGNED	P. Y. LU
TRACING					
CHECKED	W. T. CHAU	SIGNED	W. T. CHAU	SIGNED	P. Y. LU
SUPERVISOR					

PROJECT NO. 10106-1-4
 CONTRACT NO. 10106-1-4
 PROJECT NO. 10106-1-4

HANDLING OF SURPLUS PUBLIC FILL (2014-2016)

DRAWING TITLE
TSEUNG KWAN O AREA 137 FILL BANK - GENERAL LAYOUT OF EXISTING FACILITIES

DRAWING NO. **FM10068-6**
 SCALE 1:1000
 SHEET NO. 45 OF 48
 OFFICE: **FILL MANAGEMENT DIVISION CIVIL ENGINEERING OFFICE**
CEDD
 CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT

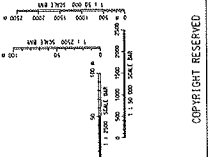

814500K

814500K

COPYRIGHT RESERVED



Appendix I

K

Monitoring Schedule for the Coming Month

Contract No. CV/2013/06 Handling of Surplus Public Fill
Tseung Kwan O Area137

Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hr TSP & 24-hr TSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitoring (NM)

April 2016

Sun	Mon	Tue	Wed	Thu	Fri	Sat
27	28	29 <u>24 hr TSP</u>	30 <u>1-hr TSP x 2</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-flood (08:30-10:30) Mid-ebb (15:30-17:30)	31	1 / 4 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (17:15-19:15)	2 <u>24 hr TSP</u>
3	4	5	6 <u>1-hr TSP x 3</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-ebb (11:00 -13:00) Mid-flood (16:00 -18:00)	7	8 <u>1-hr & 24 hr TSP</u> <u>WQM</u> Mid-ebb (12:00 -14:00) Mid-flood (17:30 -19:30)	9
10	11 <u>1-hr & TSP</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (14:00-16:00)	12	13 <u>1-hr TSP</u> <u>NM</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-flood (09:30-11:30) Mid-ebb (16:00-18:00)	14 <u>24 hr TSP</u>	15 <u>1-hr TSP x2</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (18:15-20:15)	16
17	18 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (10:00 -12:00) Mid-flood (15:00 -17:00)	19	20 <u>1-hr & 24 hr TSP</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-ebb (11:00 -13:00) Mid-flood (16:30 -18:30)	21	22 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (11:30 -13:30) Mid-flood (17:30 -19:30)	23
24	25 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (13:00-15:00)	26 <u>24 hr TSP</u>	27 <u>1-hr x 2</u> <u>24 hr TSP</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (14:00-16:00)	28	29 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:30-10:30) Mid-ebb (15:30-17:30)	30



Appendix I

L

Complaint Log


Complaint Logs

Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
001	Siu Sai Wan Promenade	13 October 2014	One complaint was received via the Hotline on 13 October 2014 from a district councillor of Eastern District Council (Ref No.: H22/RS/00025513-14) against the dust emission from South East New Territories Landfill or Tsueng Kwan O 137 Fill Bank observed from a resident during the way at Siu Sai Wan Promenade in early October 2014. The complainant complained that the dust emission caused an environmental nuisance.	<p>After received the details of the complaint from the Contractor on 11 November 2014, ET have performed a site inspection on 11 November 2014 to investigate this event. During the site inspection, no fugitive dust emission was recorded within the working areas of the Fill Bank.</p> <p>Besides, refer to the dust monitoring data and ET weekly site inspections during the early October 2014, no evidence showed that fugitive dust emission was observed. Hence no further action was required.</p> <p>Due to this event, the Contractor was reminded to take more effort on the frequency of watering on site especially during dry weather.</p>	Closed



Appendix I

Figures

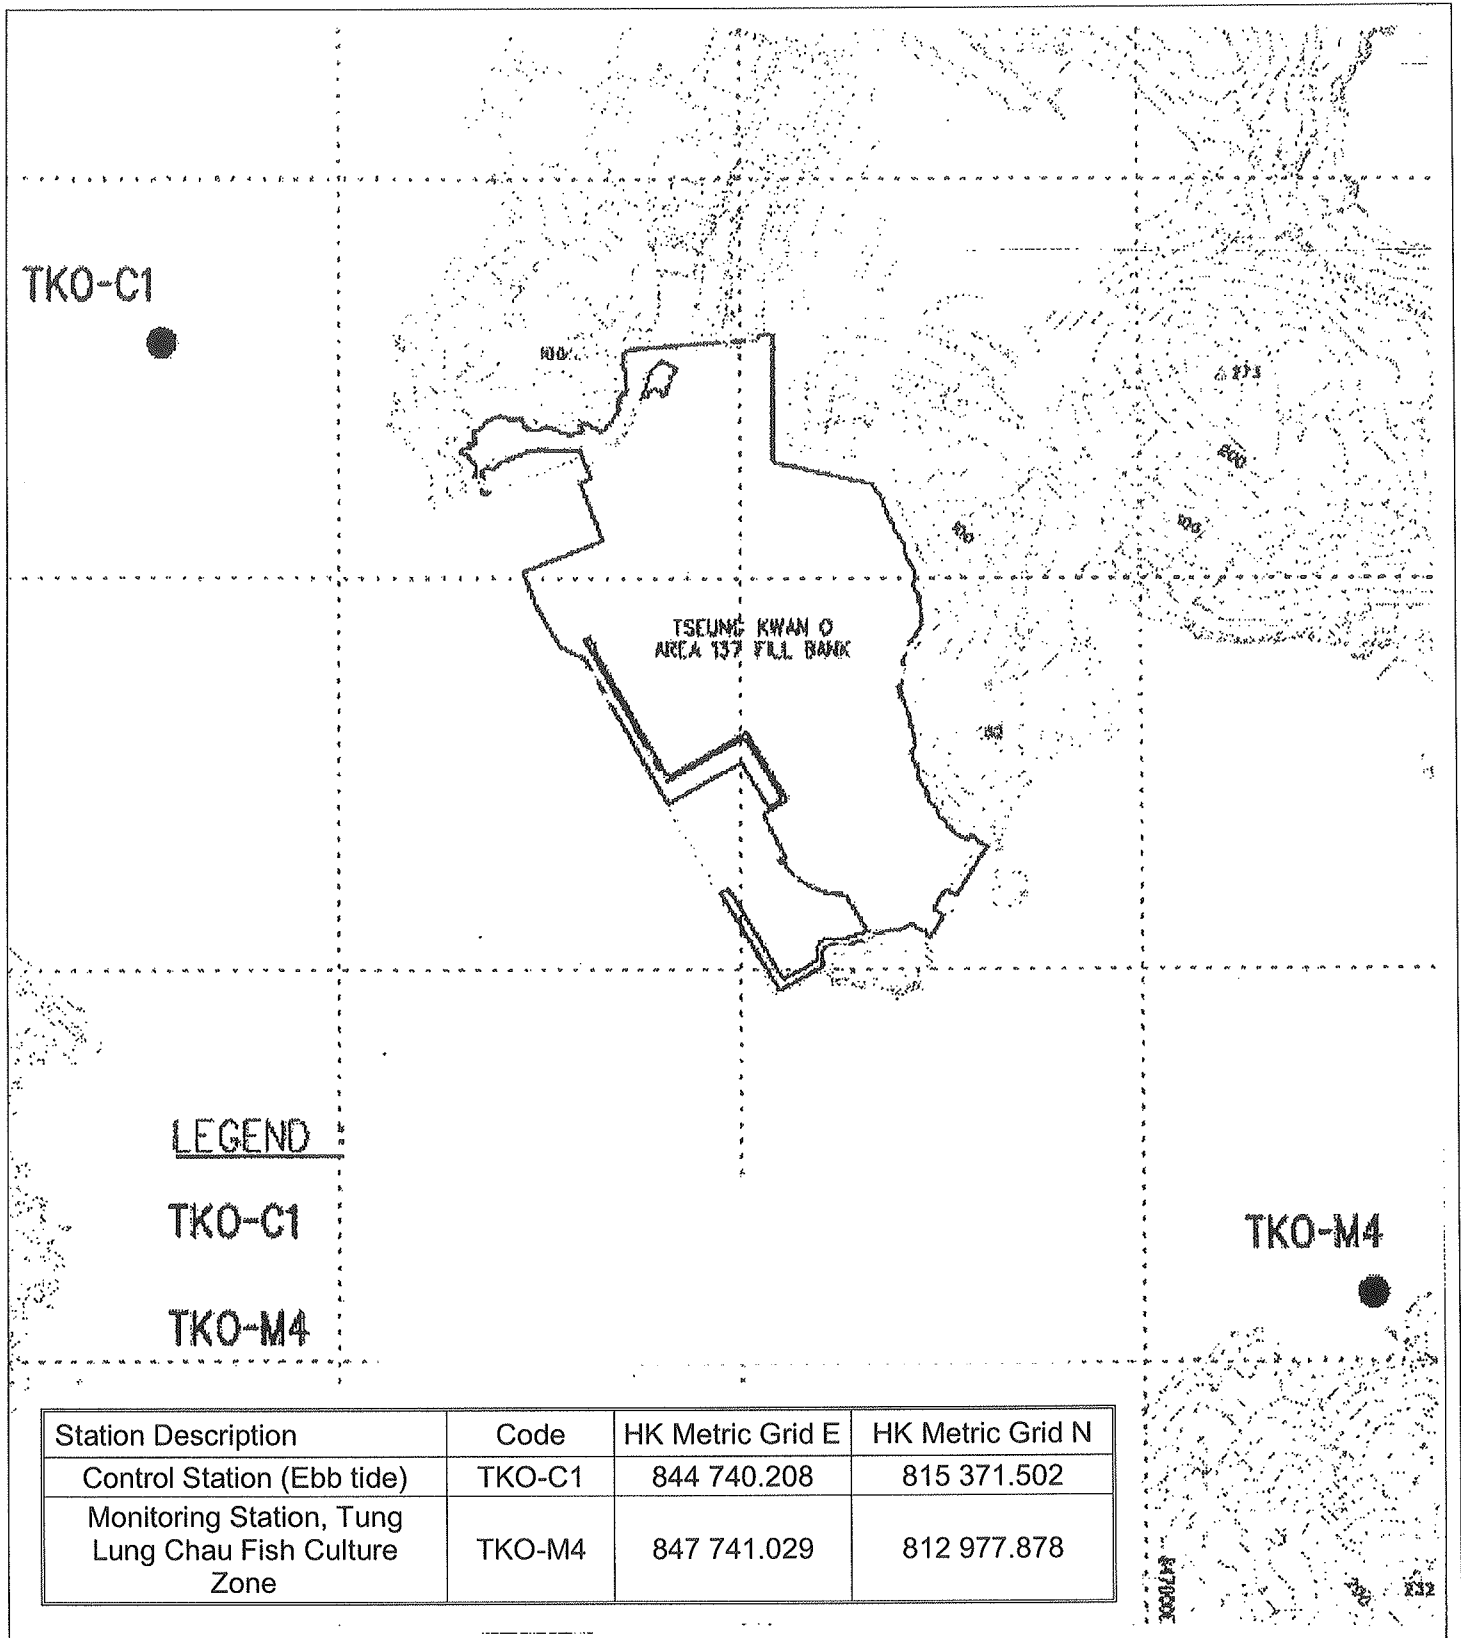


Contract No. CV/2013/06
 Handling of Surplus Public Fill (2014-2016)

Figure 1
 Locations of Water Quality Monitoring Stations –
 Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司
 ETS-TESTCONSULT LIMITED

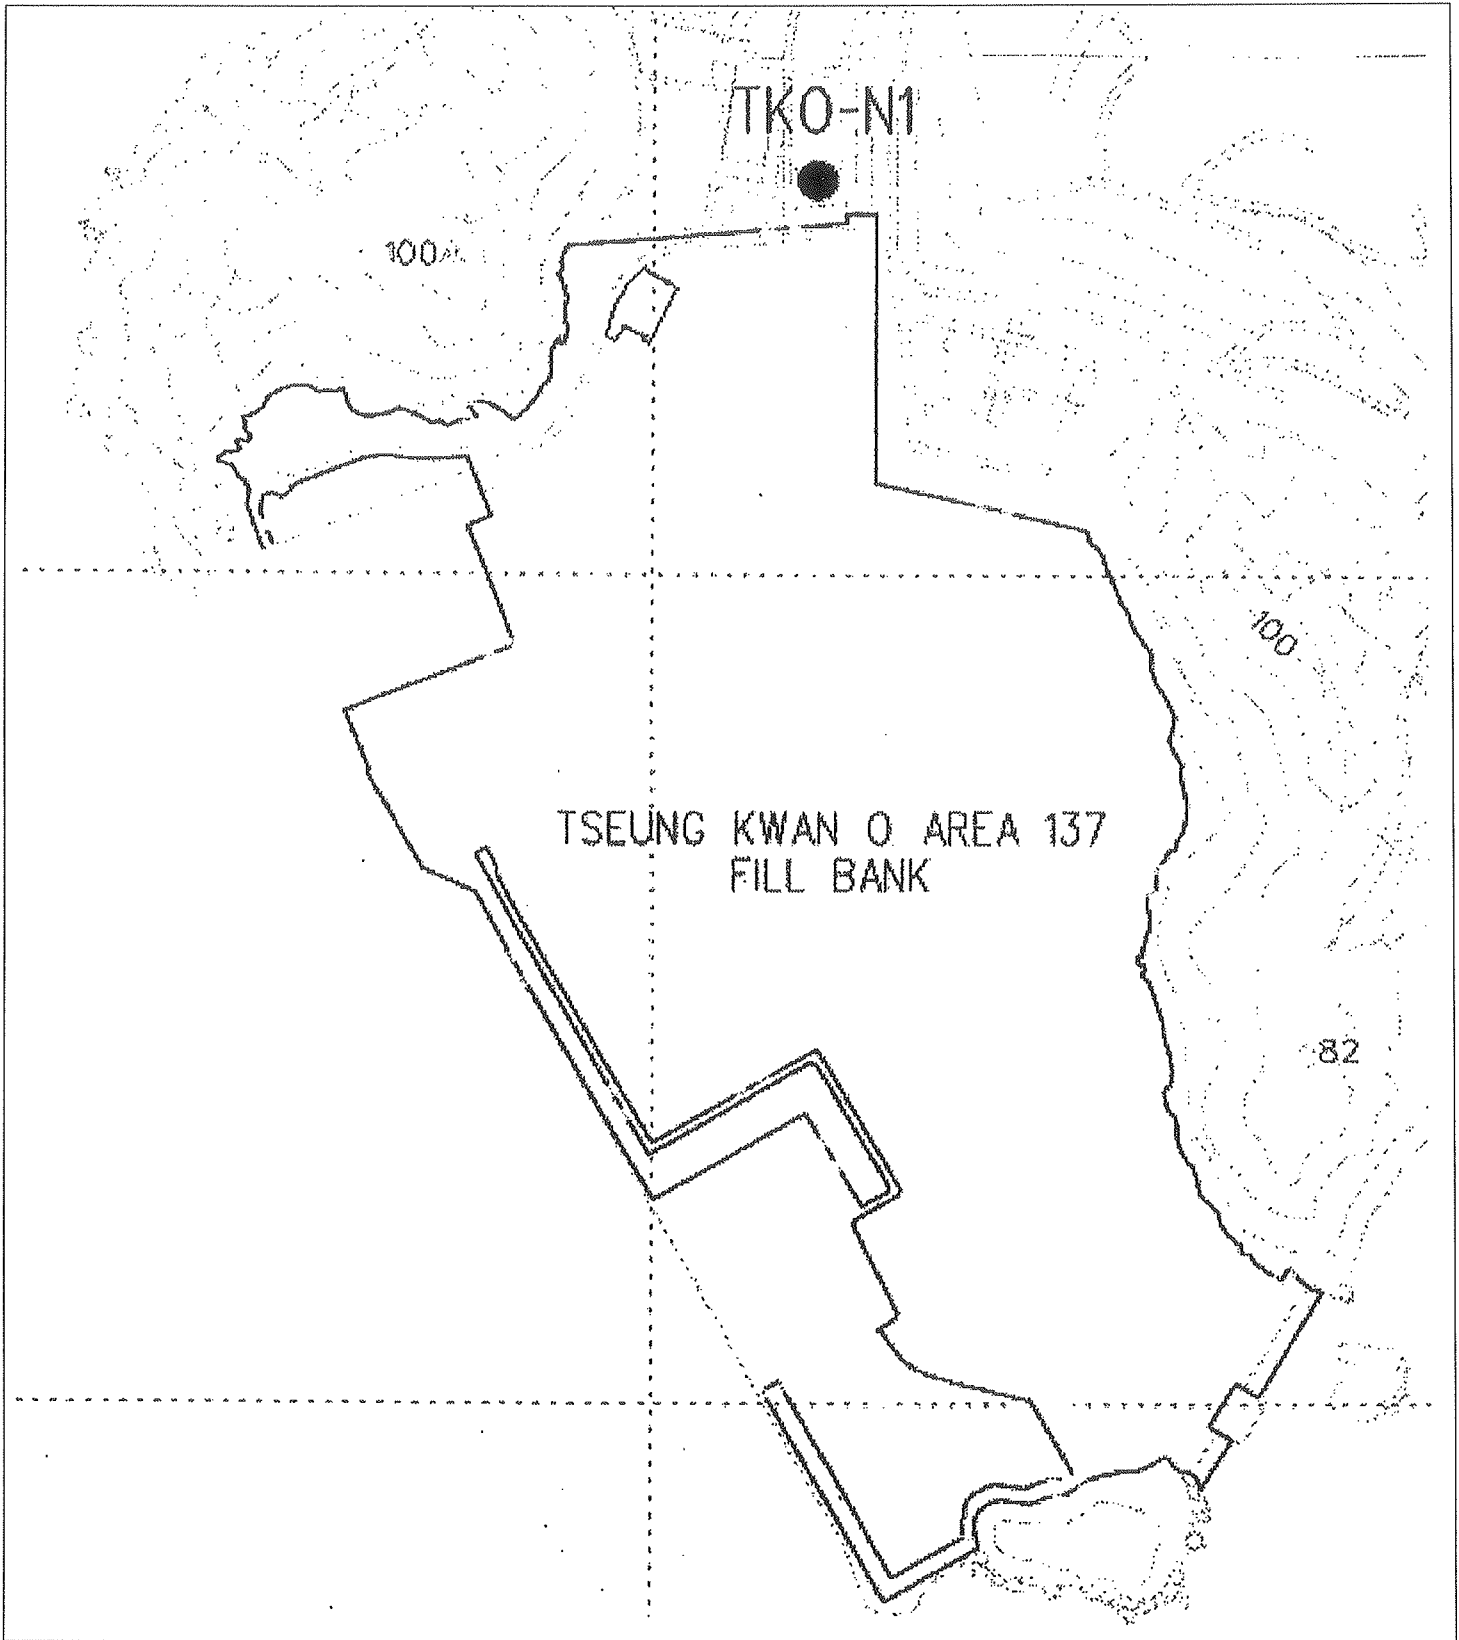


Contract No. CV/2013/06
 Handling of Surplus Public Fill (2014-2016)

Figure 2
 Location of Noise Monitoring Station –
 Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司
 ETS-TESTCONSULT LIMITED

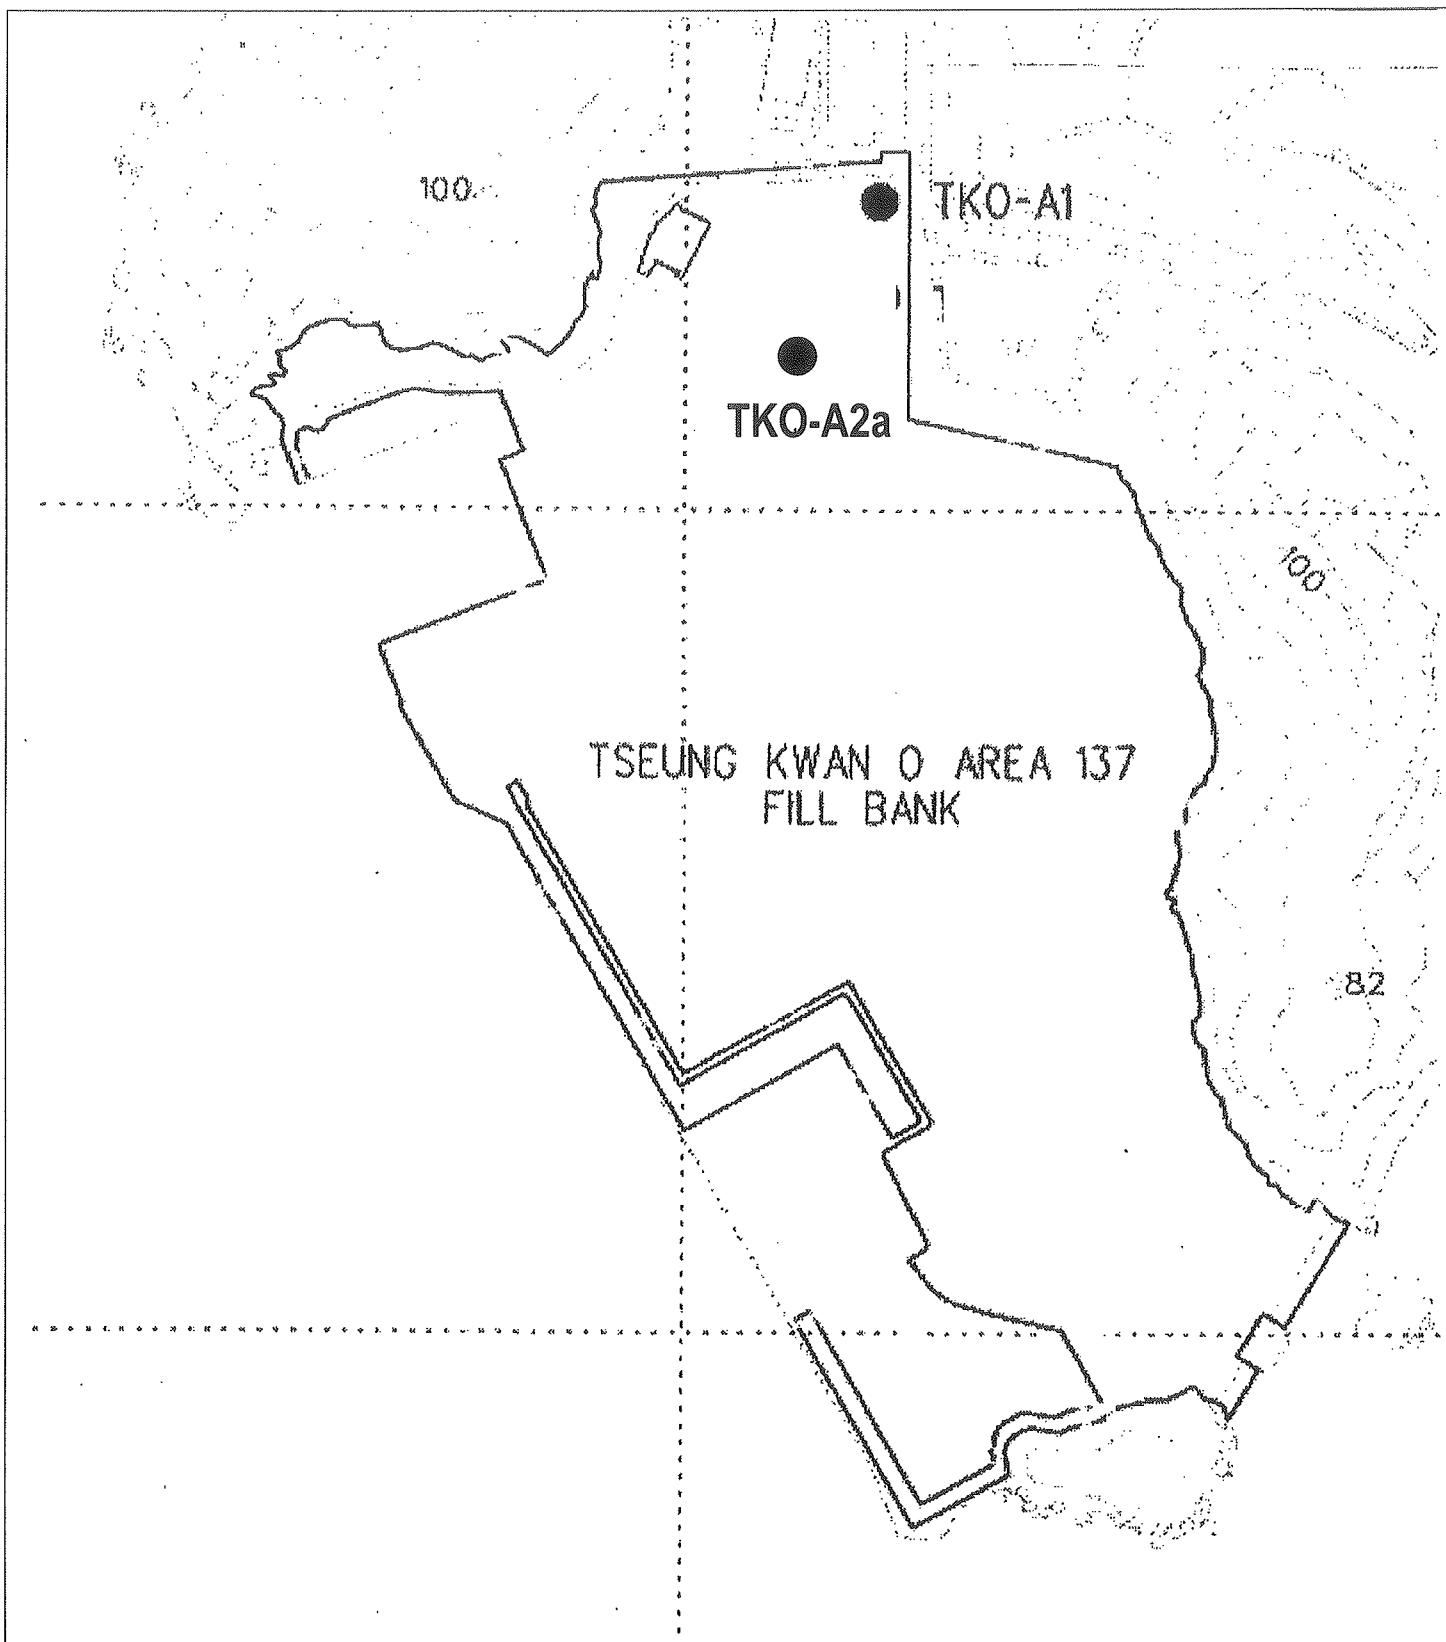


Contract No. CV/2013/06
Handling of Surplus Public Fill (2014-2016)

Figure 3
Locations of Air Quality Monitoring Stations –
Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED



Appendix II

**Marine Water Quality Monitoring Report for Contract No. HY/2010/02
Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing
Facilities – Reclamation Works**



China Harbour Engineering Company Limited

Contract No. HY/2010/02

**Hong Kong – Zhuhai – Macao Bridge
Hong Kong Boundary Crossing
Facilities –
Reclamation Works**

**Impact Water Quality Monitoring Report
for TKO 137 Fill Bank
March 2016**

[04/2016]

	Name	Signature
Prepared & Checked:	Lemon Lam	
Reviewed & Approved:	Y T Tang	

Version:	Rev. 0	Date: 13 April 2016
Disclaimer		
<p>This report is prepared for China Harbour Engineering Company Limited and is given for its sole benefit in relation to and pursuant to Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities-Reclamation Works and may not be disclosed to, quoted to or relied upon by any person other than China Harbour Engineering Company Limited without our prior written consent. No person (other than China Harbour Engineering Company Limited) into whose possession a copy of this report comes may rely on this report without our express written consent and China Harbour Engineering Company Limited may not rely on it for any purpose other than as described above.</p>		

AECOM Asia Co. Ltd.
15/F, Grand Central Plaza, Tower 1, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong
Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com

TABLE OF CONTENTS

	Page
EXECUTIVE SUMMARY	i
1 INTRODUCTION	1
1.1 Background	1
1.2 Purpose of the Report	1
1.3 Structure of the Report	1
2 WATER QUALITY	2
2.1 Monitoring Requirements	2
2.2 Monitoring Equipment	2
2.3 Monitoring Parameters, Frequency and Duration	2
2.4 Monitoring Locations	2
2.5 Monitoring Methodology	3
2.6 Action and Limit Levels	4
3 MONITORING RESULTS	5
4 CONCLUSIONS	6

List of Tables

Table 2.1	Water Quality Monitoring Equipment.....	2
Table 2.2	Water Quality Monitoring Parameters, Frequency and Duration	2
Table 2.3	Location of Water Quality Impact Stations	3
Table 2.4	Action and Limit Levels for Water Quality	4
Table 2.5	Summary of Marine Water Monitoring Results for Mid-ebb Tide	5
Table 2.6	Summary of Marine Water Monitoring Results for Mid-flood Tide	5
Table 2.7	Summary of Marine Water Monitoring Exceedance.....	5

List of Figures

Figure 1.1	Site Layout Plan for TKO 137 Fill Bank
Figure 2.1	Impact Water Quality Monitoring Stations at TKO 137 Fill Bank

List of Appendices

Appendix A	Calibration Records
Appendix B	Impact Monitoring Schedules
Appendix C	Impact Water Quality Monitoring Results and their Graphical Presentation
Appendix D	QA/QC Report

EXECUTIVE SUMMARY

On-site sorting facilities for imported material (public fill) for reclamation works of the “Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below known as “the Works Area). Impact monitoring of water quality was conducted at the designated monitoring location. This report presents the impact monitoring results regarding water quality aspects performed in March 2016.

According to the Contractor information, the transportation and operation of the mentioned facility was suspended on 16 November 2015.

Water Quality

Impact water quality monitoring was conducted at three monitoring stations, C1a, M4a & M5. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations. The impact monitoring was carried out three times per week (from 1 to 31 March 2016) during the operation of the mentioned facilities for both mid-ebb and mid-flood tides. Data of temperature, salinity, dissolved oxygen (DO), turbidity (Tby) and suspended solids (SS) were collected and analysed. Details of the monitoring methodology, locations and results are presented in this report.

Breaches of Action and Limit Levels for Water Quality

No exceedance of Action and Limit Level of water quality monitoring results related to the Project was recorded in the reporting month.

1 INTRODUCTION

1.1 Background

- 1.1.1 Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) mainly comprises reclamation at the northeast of the Hong Kong International Airport of an area of about 130-hectare for the construction of an artificial island for the development of the Hong Kong Boundary Crossing Facilities (HKBCF), and about 19-hectare for the southern landfall of the Tuen Mun - Chek Lap Kok Link (TMCLKL).
- 1.1.2 On-site sorting facilities for imported material (public fill) for reclamation works of the Project were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below, known as “the Works Area”). The proposed sorting facilities together with barging points, tipping halls and associated facilities will be installed at the Works Area.
- 1.1.3 The latest Environmental Permit (EP) for Fill Bank at TKO Area 137 was issued on 4 February 2013 (EP-134/2002/K) by the Environmental Protection Department (EPD) to Civil Engineering and Development Department (CEDD), the Permit Holder, regarding the Project. Condition 3.2 of the EP requires the water quality monitoring frequency and parameters at stations C1a, M4a and M5 shall be same as the requirements set out in the EM&A Manual for TKO 137 Fill Bank (here below, known as “EM&A Manual”) and the monitoring results shall be incorporated in the monthly EM&A reports.
- 1.1.4 According to the Contractor information, the transportation and operation of the mentioned facility was suspended on 16 November 2015.

1.2 Purpose of the Report

- 1.2.1 The purpose of this impact monitoring report is to assess environmental impact and compliance during transportation and operation of the mentioned facilities for the Project. This report presents the impact monitoring requirements, methodologies and results of water quality measurements in accordance with the EM&A Manual.
- 1.2.2 This impact report presents the monitoring works of water quality monitoring, at two monitoring stations (M4a and M5) and one control station (C1a), conducted in March 2016. A layout plan of the Works Area is provided in Figure 1.1.

1.3 Structure of the Report

- 1.3.1 The structure of the report is as follows:

Section 1: Introduction, background, purpose and the structure of the report.

Section 2: Water quality, which describes the impact water quality monitoring requirements, methodology and action/limit level.

Section 3: Impact water quality monitoring results.

Section 4: Conclusions.

2 WATER QUALITY

2.1 Monitoring Requirements

2.1.1 Impact marine water quality monitoring at 3 water quality monitoring stations should be established. In accordance with the EM&A Manual, impact water quality monitoring should be conducted 3 days per week during the operation of the facilities in the Works Area. Moreover, as stipulated in the latest EP, water quality monitoring should be conducted since 2 weeks before commencement of operation of the additional barging points. Measurements shall be taken at the 3 designated stations, 2 impact and 1 control stations at mid-flood and mid-ebb tides at three water depths, i.e., 1 m below surface, mid-depth and 1 m from seabed.

2.2 Monitoring Equipment

2.2.1 Equipment used in the impact water quality monitoring programme is summarized in Table 2.1. A copy of the calibration certificates for the water quality monitoring equipment are attached in Appendix A.

Table 2.1 Water Quality Monitoring Equipment

Parameter	Model and Make
Coordinate of Monitoring stations	Garmin etrex 10
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI Pro2030
Turbidity	HACH Model 2100Q Turbid Meter
Water Depth	Speedtech Instrument SM-5A

2.3 Monitoring Parameters, Frequency and Duration

2.3.1 Table 2.2 summarises the monitoring parameters, frequency and duration of impact water quality monitoring. Impact water quality monitoring was carried out at three stations in March 2016. Detailed impact water quality monitoring schedule was provided in Appendix B.

Table 2.2 Water Quality Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter, unit	Frequency	No. of Depths
<p><i>Control Stations:</i> C1a</p> <p><i>Impact Stations:</i> M4a – M5</p>	<ul style="list-style-type: none"> • Depth, m • Temperature, °C • Salinity, ppt • DO, mg/L • DO Saturation, % • Turbidity, NTU • Suspended Solids (SS), mg/L 	<p>Three times per week during mid-ebb and mid-flood tides (within ± 1.75 hour of the predicted time)</p>	<p>3 (1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth is less than 6 m, in which case the mid-depth station may be omitted. Should the water depth be less than 3 m, only the mid-depth station will be monitored).</p>

2.4 Monitoring Locations

2.4.1 The measurements were taken at all designated impact and control stations summarized in Table 2.3. The two impact stations were chosen on the basis of their proximity to the Works Area, which would be under the greatest potential for water quality impacts. In addition, a control station was also set up for ebb-tide references respectively of the surrounding ambient.

Table 2.3 Location of Water Quality Impact Stations

Station I.D.	HK 1980 Grid		Status
	Easting	Northing	
C1a	845647	814146	Control Station (Ebb-tide)
M4a	845922	813973	Impact Station (Close to Additional Barging Point, Tipping Halls and Associated Facilities at TKO 137 Fill Bank)
M5	847005	813678	Impact Station (Close to Tai Miu Wan)

2.5 Monitoring Methodology

2.5.1 Instrumentation

- (a) The in-situ water quality parameters, viz. dissolved oxygen, temperature, salinity and turbidity were measured by multi-parameter meters and turbidity was measured by Turbid Meter.

2.5.2 Operating/Analytical Procedures

- (a) A hand-held digital Global Positioning Systems (GPS) were used to ensure that the correct location was selected prior to sample collection.
- (b) Portable, battery-operated echo sounders were used for the determination of water depth at each designated monitoring station.
- (c) All in-situ measurements were taken at 3 water depths, 1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth was less than 6 m, in which case the mid-depth station was omitted. Should the water depth be less than 3 m, only the mid-depth station was monitored.
- (d) At each measurement/sampling depth, two consecutive in-situ monitoring (DO concentration and saturation, temperature, turbidity, salinity) and water sample for SS were collected. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO concentration and saturation, temperature and salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. Where the difference in the value between the first and second readings of DO or turbidity parameters was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- (e) Duplicate samples from each independent sampling event were collected for SS measurement. Water samples were collected using the water samplers and the samples were stored in high-density polythene bottles. Water samples collected were well-mixed in the water sampler prior to pre-rinsing and transferring to sample bottles. Sample bottles were pre-rinsed with the same water samples. The sample bottles were then be packed in cool-boxes (cooled at 4°C without being frozen), and delivered to Environmental Laboratory, ETS-Testconsult Ltd. (HOKLAS Registration No. 022) for the analysis of suspended solids concentrations. The laboratory determination work would be started within 24 hours after collection of the water samples. Environmental Laboratory, ETS-Testconsult Ltd., is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes. For QA/QC procedures, one duplicate samples of every batch of 20 samples was analyzed and attached in Appendix D.

2.5.3 Maintenance and Calibration

- (a) Before each round of monitoring, the dissolved oxygen probe of YSI Pro2030 was calibrated by the wet bulb method.
- (b) The monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS before use and subsequently re-calibrated at 3-monthly intervals throughout all stages of the water quality monitoring.

2.6 Action and Limit Levels

2.6.1 The Action and Limit Levels (AL levels) have been set in accordance with the derivation criteria specified in the EM&A Manual. This is shown in Table 2.4.

Table 2.4 Action and Limit Levels for Water Quality

Parameters	Action	Limit
DO in mg/L (Surface & Middle, Bottom)	Surface & Middle 5.5 mg/L Bottom 5.2 mg/L	Surface & Middle 4.0 mg/L Bottom 2.0 mg/L
SS in mg/L (depth-averaged)	4.9 mg/L or 120% of upstream control station's SS at the same tide of the same day	5.2 mg/L or 130% of upstream control station's SS at the same tide of the same day and specific sensitive receiver water quality requirements (e.g. required suspended solids level at FCZ)
Turbidity in NTU (depth-averaged)	3.9 NTU or 120% of upstream control station's turbidity at the same tide of the same day	4.2 NTU or 130% of upstream control station's turbidity at the same tide of the same day

- Notes:
1. "depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
 2. For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
 3. For turbidity, SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.
 4. All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.

3 MONITORING RESULTS

3.1.1 The impact water quality monitoring results for C1a, M4a and M5 are summarized in Tables 2.5 and 2.6. Detail water quality monitoring results are presented in Appendix C.

Table 2.5 Summary of Marine Water Monitoring Results for Mid-ebb Tide

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	16.5 (14.9 - 18.2)	28.8 (27.3 - 30.7)	7.1 (6.7 - 8.4)	7.1 (6.6 - 8.2)	86.9 (79.8 - 103.6)	2.1 (1.3 - 3.9)	2.6 (1.5 - 5)
M4a	16.5 (14.9 - 17.9)	28.9 (27.3 - 30.8)	7.1 (6.6 - 8.5)	7.1 (6.5 - 8.3)	86.7 (79.8 - 103.8)	1.9 (1.2 - 3)	2.5 (1.5 - 4.1)
M5	16.5 (14.9 - 18.1)	28.8 (27.3 - 30.6)	7.1 (6.5 - 8.6)	7.0 (6.3 - 8.3)	85.9 (78.9 - 104.9)	1.9 (1.1 - 3.2)	2.6 (1.4 - 4.8)

Table 2.6 Summary of Marine Water Monitoring Results for Mid-flood Tide

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	16.5 (15.1 - 18.1)	28.8 (27.3 - 30.7)	7.3 (6.8 - 8.5)	7.2 (6.6 - 8.3)	88.7 (80.6 - 104.6)	2.0 (1.2 - 3.4)	2.6 (1.4 - 4.7)
M4a	16.5 (15.2 - 18)	28.8 (27.3 - 30.4)	7.3 (6.7 - 8.6)	7.1 (6.6 - 8.4)	88.2 (80.5 - 104.8)	1.8 (1.2 - 3.2)	2.3 (1.5 - 4.1)
M5	16.5 (15.1 - 18)	28.8 (26 - 30.5)	7.1 (6.6 - 8.7)	7.1 (6.4 - 8.4)	86.5 (79.7 - 105.9)	1.9 (1 - 3.2)	2.4 (1.3 - 4.4)

3.1.2 The weather conditions during the monitoring period were generally cloudy. Sea conditions for the majority of monitoring days were generally small wave. No major water pollution source, which might affect the result observed during the impact monitoring period.

3.1.3 Since the water depths at all the monitoring stations were generally higher than 6m, sampling was conducted at three water depths at each station.

3.1.4 The summary of impact water quality exceedance related to the Project is shown in Table 2.7.

Table 2.7 Summary of Marine Water Monitoring Exceedance

Monitoring Station	Exceedance Level	DO (SM)		DO(Bottom)		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
M4a	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0
M5	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0


Note: S: Surface; and
 M: Mid-depth.

3.1.5 No exceedance of Action and Limit Level of water quality monitoring results related to the Project was recorded in the reporting month.

4 CONCLUSIONS

- 4.1.1 This impact monitoring report presents impact monitoring results for water quality at designated locations C1a, M4a and M5 in accordance with the EM&A Manual. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations.
- 4.1.2 All laboratory results satisfied the QA/QC requirements and all monitoring equipment is properly calibrated and with valid calibration certificates.
- 4.1.3 According to the Contractor information, the transportation and operation of the mentioned facility was suspended on 16 November 2015.
- 4.1.4 No exceedance of Action and Limit Level of water quality monitoring results related to the Project was recorded in the reporting month.

FIGURES

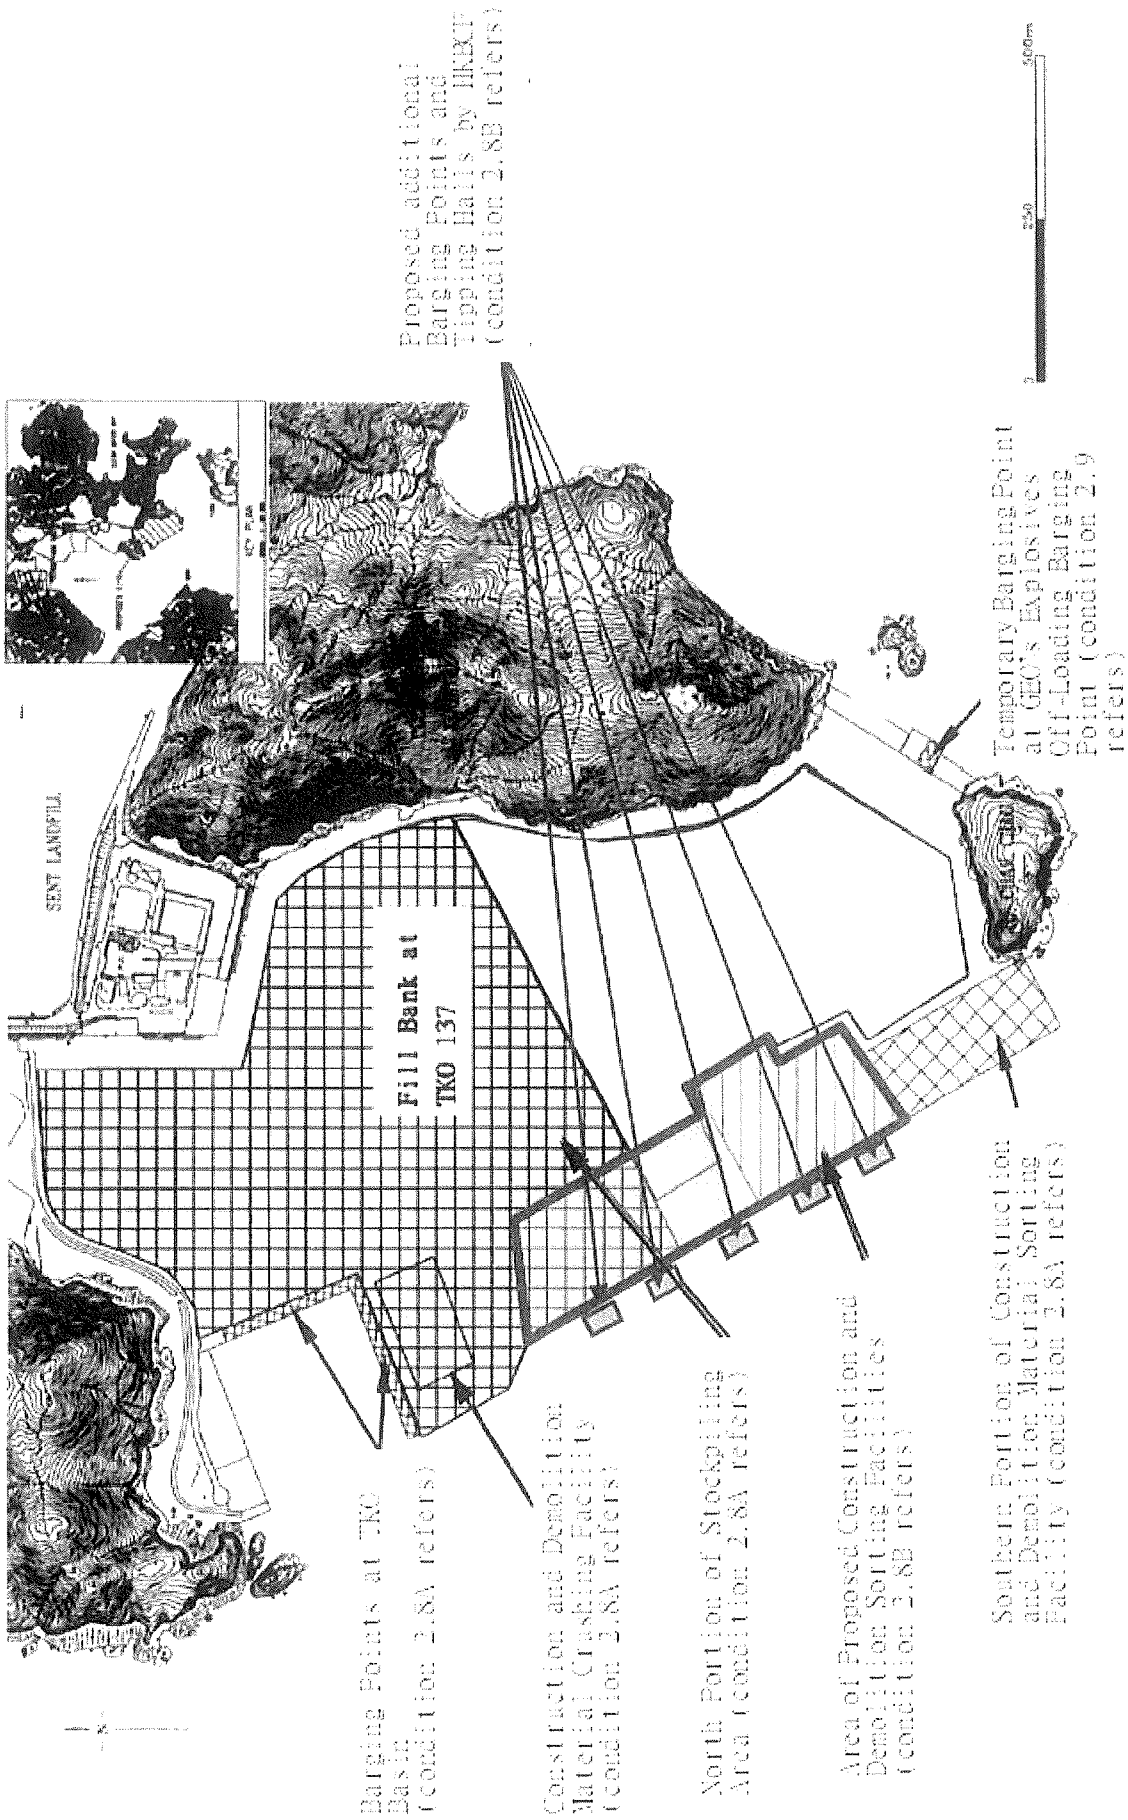

Barging Points at TKO Basin
(condition 2.8A refers)

Construction and Demolition
Material Crushing Facility
(condition 2.8A refers)

North Portion of Stockpiling
Area (condition 2.8A refers)

Area of Proposed Construction and
Demolition Sorting Facilities
(condition 2.8B refers)

Southern Portion of Construction
and Demolition Material Sorting
Facility (condition 2.8A refers)

Fill Bank at
TKO 137

Temporary Barging Point
at GEO's Explosives
Off-Loading Barging
Point (condition 2.9
refers)

Proposed additional
Barging Points and
Tipping Halls by HKBU
(condition 2.8B refers)




(Plan Originated from Figure 2 of Environmental Permit No.: EP-134/2002(K))

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsoever, to any party that uses or relies on this drawing without AECOM's express written consent. Do not scale this document. All measurements must be obtained from the stated dimensions.

**HONG KONG - ZHUHAI - MACAO BRIDGE
HONG KONG BOUNDARY CROSSING FACILITIES
RECLAMATION WORKS**

Site Layout Plan for TKO 137 Fill Bank



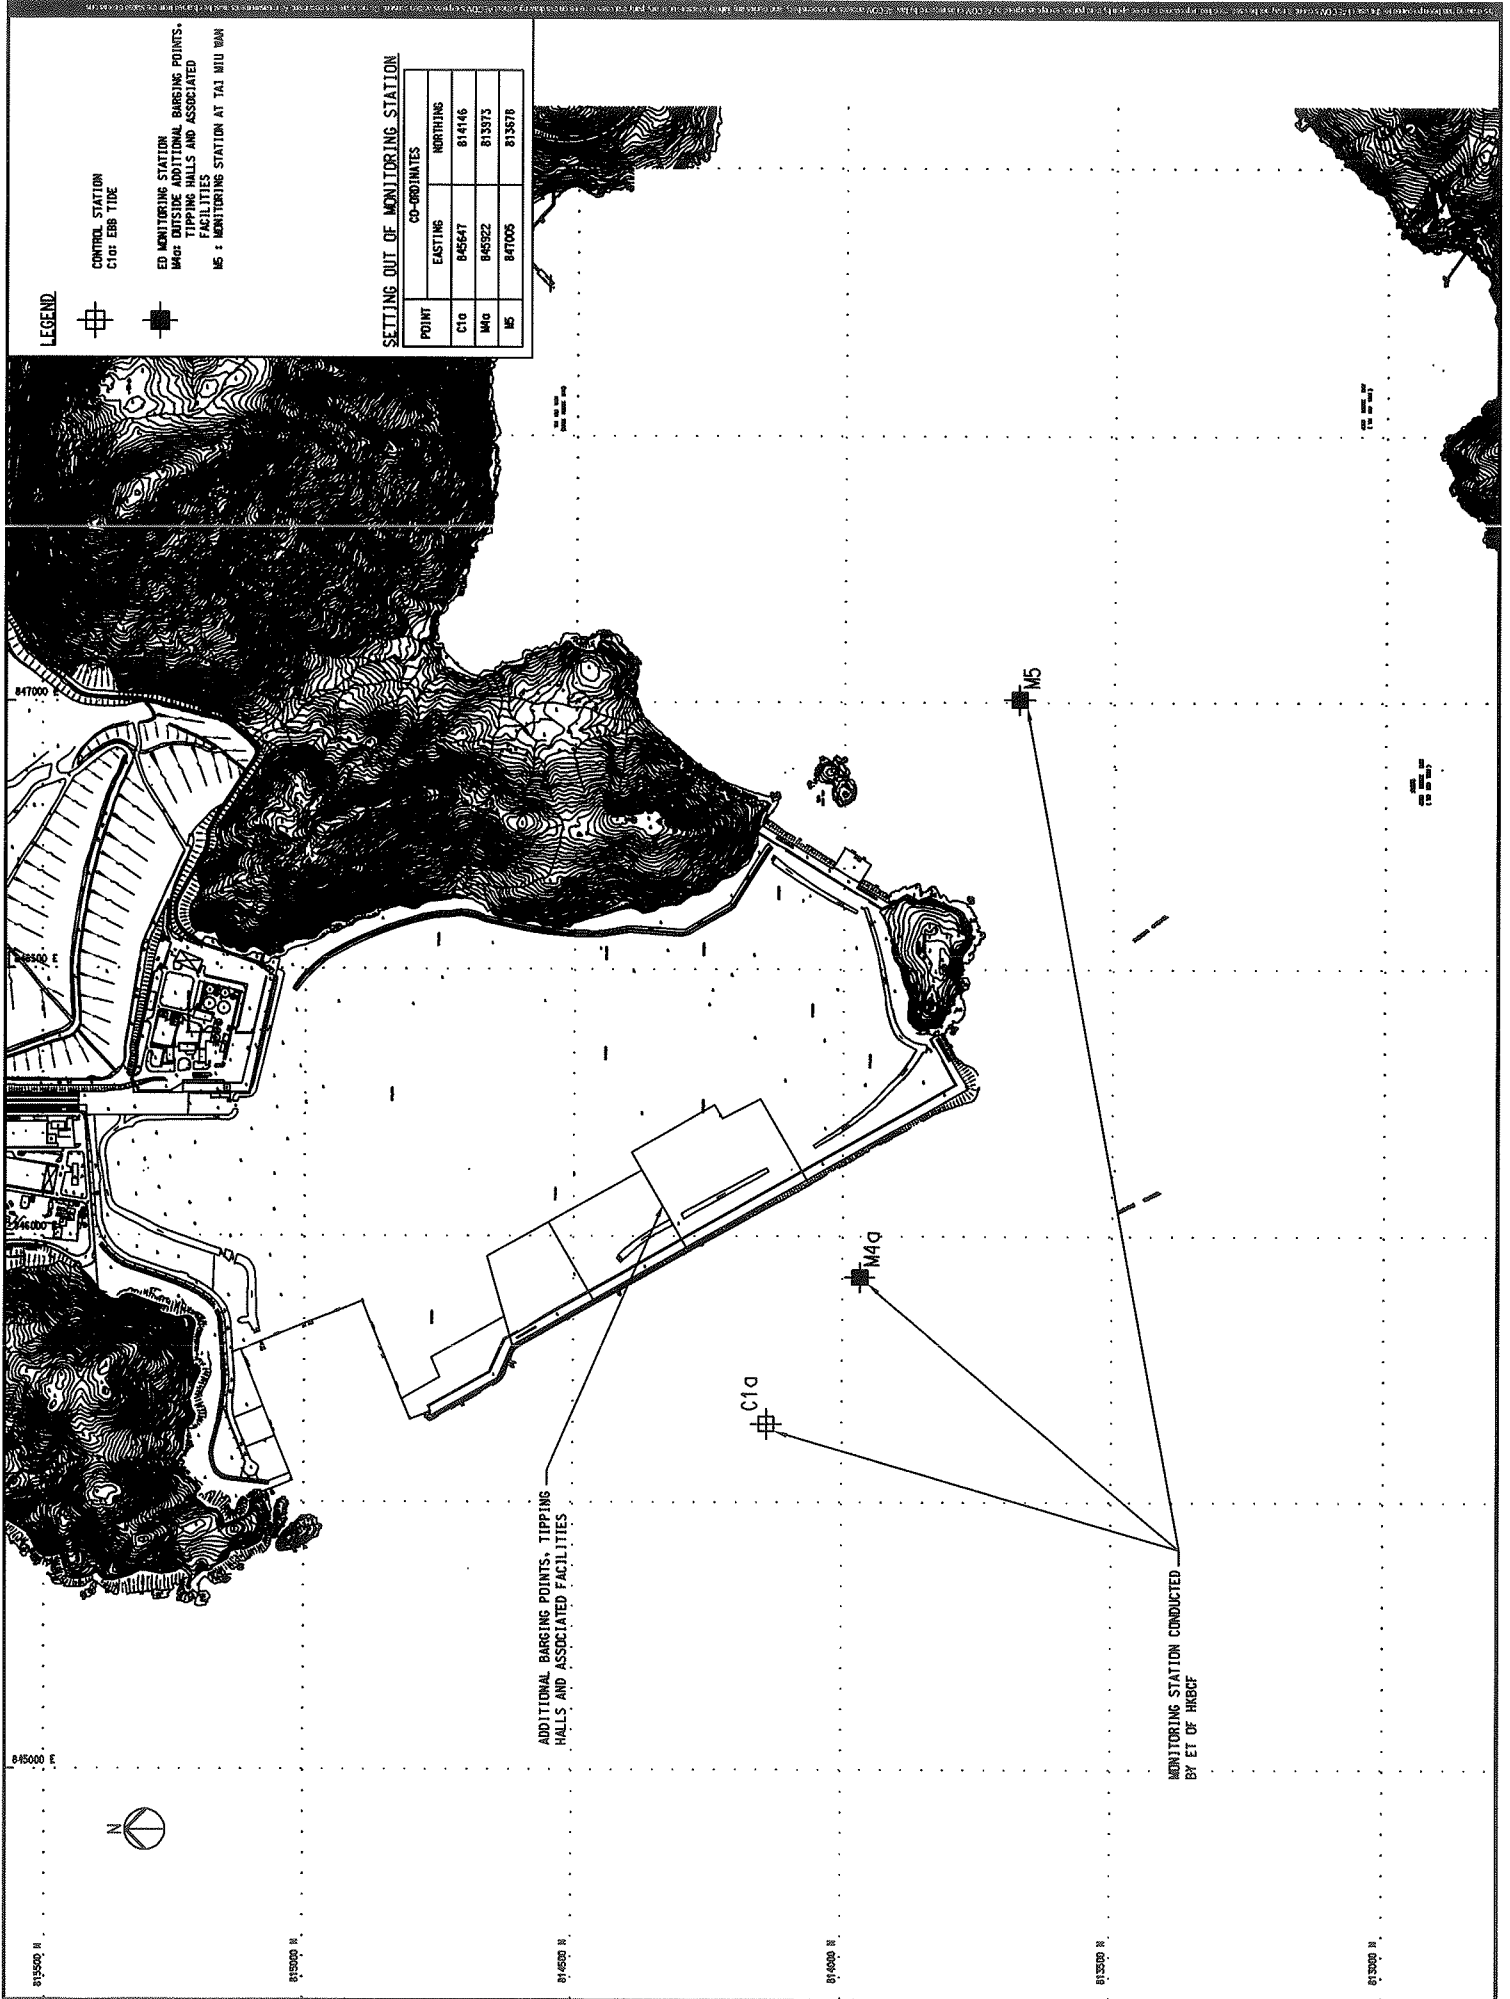

**APPENDIX A
CALIBRATION RECORDS**



Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/001</u>	Manufacturer : <u>YSI</u>
Model No. : <u>85</u>	Serial No. : <u>05L 1285</u>
Date of Calibration : <u>30/01/2016</u>	Calibration Due Date : <u>29/04/2016</u>

Temperature Verification

Ref. No. of Reference Thermometer : ET/0521/017

Ref. No. of Water Bath : ---

	Temperature (°C)			
	Reference Thermometer reading	Measured	Corrected	
		20.0		19.9
DO Meter reading	Measured	20.0	Difference	-0.1

Standardization of sodium thiosulphate (Na₂S₂O₃) solution

Reagent No. of Na ₂ S ₂ O ₃ titrant	<u>CPE/012/4.5/001/13</u>	Reagent No. of 0.025N K ₂ Cr ₂ O ₇	<u>CPE/012/4.4/002/06</u>
		Trial 1	Trial 2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)		0.00	10.20
Final Vol. of Na ₂ S ₂ O ₃ (ml)		10.20	20.50
Vol. of Na ₂ S ₂ O ₃ used (ml)		10.20	10.30
Normality of Na ₂ S ₂ O ₃ solution (N)		0.02451	0.02427
Average Normality (N) of Na ₂ S ₂ O ₃ solution (N)		0.02439	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na₂S₂O₃, N = 0.25 / ml Na₂S₂O₃ used

Lineality Checking

Determination of dissolved oxygen content by Winkler Titration *

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	11.10	22.00	0.00	6.90	10.40
Final Vol. of Na ₂ S ₂ O ₃ (ml)	11.10	22.00	28.80	6.90	10.40	14.20
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	11.10	10.90	6.80	6.90	3.50	3.80
Dissolved Oxygen (DO), mg/L	7.27	7.14	4.45	4.52	2.29	2.49
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.28	7.31	7.30	7.27	7.14	7.21	1.24
5	4.22	4.26	4.24	4.45	4.52	4.49	5.73
10	2.28	2.33	2.31	2.29	2.49	2.39	3.40
Linear regression coefficient				0.9969			



Internal Calibration Report of Dissolved Oxygen Meter

Zero Point Checking

DO meter reading, mg/L	0.00
------------------------	------

Salinity Checking

Reagent No. of NaCl (10ppt)	CPE/012/4.7/003/14	Reagent No. of NaCl (30ppt)	CPE/012/4.8/003/14
-----------------------------	--------------------	-----------------------------	--------------------

Determination of dissolved oxygen content by Winkler Titration **

Salinity (ppt)	10		30	
	1	2	1	2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	11.40	22.80	32.50
Final Vol. of Na ₂ S ₂ O ₃ (ml)	11.40	22.80	32.50	42.10
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	11.40	11.40	9.70	9.60
Dissolved Oxygen (DO), mg/L	7.46	7.46	6.35	6.29
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: $DO (mg/L) = V \times N \times 8000/298$

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.22	7.29	7.26	7.46	7.46	7.46	2.72
30	6.44	6.40	6.42	6.35	6.29	6.32	1.57

Acceptance Criteria

- (1) Differenc between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / ~~does not comply~~ # with the specified requirements and is deemed acceptable # / unacceptable # for use.

Delete as appropriate

Calibrated by : _____

Approved by : _____



Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/001 Manufacturer : YSI
 Model No. : 85 Serial No. : 05L 1285
 Date of Calibration : ²⁶~~30~~/01/2016 Due Date : ²⁵~~29~~/04/2016

Ref. No. of Salinity Standard used (30ppt)

S/001/6

Salinity Standard (ppt)	Measured Salinity (ppt)	Difference * (%)
30.0	30.6	2.00


(*) Difference (%) = (Measured Salinity – Salinity Standard value) / Salinity Standard value x 100

Acceptance Criteria

Difference : -10 % to 10 %

The salinity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 



Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/010 Manufacturer : HACH
 Model No. : 2100Q Serial No. : 11110 C 014260
 Date of Calibration : 30/12/2015 Due Date : 29/03/2015 ²⁰¹⁶ *ide*

Ref. No. of Turbidity Standard used (4000NTU)

005/6.1/001/8


Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	20.6	3.00
100	97.2	-2.80
800	780	-2.50


(*) Difference = (Measured Value – Theoretical Value) / Theoretical Value x 100

Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 



Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/012 Manufacturer : HACH

Model No. : 2100Q Serial No. : 12060 C 018447

Date of Calibration : 29/03/2016 Due Date : 28/06/2016

Ref. No. of Turbidity Standard used (4000NTU)

005/6.1/001/9

Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	19.5	-2.50
100	98.2	-1.80
800	768	-4.00

(*) Difference = (Measured Value – Theoretical Value) / Theoretical Value x 100

Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 

**APPENDIX B
IMPACT MONITORING SCHEDULES**

**Contract No. HY/2010/02 - Hong Kong-Zhuhai-Macao Bridge
 Hong Kong Boundary Crossing Facilities – Reclamation Works
 Impact Water Quality Monitoring (WQM) Schedule for March 2016 (TKO 137 Fill Bank)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	01-Mar	02-Mar	03-Mar	04-Mar	05-Mar	
		Impact WQM Mid-flood: 11:14 Mid-ebb: 19:31	Impact WQM Mid-flood: 11:14 Mid-ebb: 19:31	Impact WQM Mid-ebb: 08:48 Mid-flood: 13:27		
06-Mar	07-Mar	08-Mar	09-Mar	10-Mar	11-Mar	12-Mar
	Impact WQM Mid-ebb: 11:19 Mid-flood: 16:44		Impact WQM Mid-ebb: 12:38 Mid-flood: 18:29		Impact WQM Mid-flood: 07:57 * Mid-ebb: 14:02	
13-Mar	14-Mar	15-Mar	16-Mar	17-Mar	18-Mar	19-Mar
	Impact WQM Mid-flood: 09:57 Mid-ebb: 16:38		Impact WQM Mid-flood: 11:39 Mid-ebb: 19:16		Impact WQM Mid-ebb: 09:04 Mid-flood: 14:12	
20-Mar	21-Mar	22-Mar	23-Mar	24-Mar	25-Mar	26-Mar
	Impact WQM Mid-ebb: 11:26 Mid-flood: 17:11		Impact WQM Mid-ebb: 12:25 Mid-flood: 18:31			
27-Mar	28-Mar	29-Mar	30-Mar	31-Mar		
		Impact WQM Mid-flood: 09:29 Mid-ebb: 16:29				

The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc).

(*) Proposed WQM on 11 March 2016 will be carried out between 08:00 to 09:30 because the site works start from 08:00. The proposed WQM period is within the ebb tide (05:03 to 12:12 on 11 March 2016).

**APPENDIX C
IMPACT WATER QUALITY MONITORING
RESULTS AND THEIR GRAPHICAL
PRESENTATION**

Mid-Ebb Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)	
					Surface	Middle		Value	Ave.	Value	Average	Value	Average	Value	Average
02/03/16	1815-1825	15/Cloudy	Small Wave	17.4	Surface	1.0	15.3	28.2	7.0	28.3	83.4	2.2	2.6	2.2	2.6
							15.4	28.3	82.9	2.2	2.5				
					Middle	8.7	15.2	28.3	7.0	28.3	82.4	2.4	2.4	2.3	3.1
							15.3	28.3	82.2	2.3	3.0				
					Bottom	16.4	15.0	28.5	6.8	28.6	80.4	2.5	2.5	2.5	3.0
							15.1	28.6	80.0	2.5	2.9				
04/03/16	0824-0839	18/Fine	Small Wave	17.2	Surface	1.0	15.4	28.2	7.1	28.2	83.9	1.3	1.6	1.3	1.7
							15.4	28.2	83.4	1.3	1.7				
					Middle	8.6	15.3	28.3	7.0	28.3	82.9	1.4	1.4	1.4	1.7
							15.3	28.2	82.2	1.4	1.5				
					Bottom	16.2	15.1	28.5	6.8	28.5	81.0	1.7	1.7	1.7	2.2
							15.0	28.5	81.5	1.6	1.9				
07/03/16	1054-1112	16/Cloudy	Small Wave	17.2	Surface	1.0	15.5	27.6	6.8	27.7	85.4	1.4	1.6	1.4	1.6
							15.5	27.7	85.1	1.4	1.5				
					Middle	8.6	15.6	27.8	6.7	27.8	84.4	1.4	1.4	1.4	1.8
							15.5	27.7	84.7	1.4	1.8				
					Bottom	16.2	15.4	28.0	6.6	28.1	82.4	1.8	1.8	1.8	1.9
							15.3	28.1	82.8	1.7	1.8				
09/03/16	1154-1212	18/Cloudy	Small Wave	16.8	Surface	1.0	15.3	28.2	7.0	28.3	82.8	1.5	1.6	1.5	1.7
							15.2	28.3	82.3	1.4	1.7				
					Middle	8.4	15.2	28.4	6.9	28.4	81.9	1.5	1.5	1.5	2.1
							15.1	28.3	81.1	1.5	2.1				
					Bottom	15.8	14.9	28.5	6.8	28.6	79.8	1.8	1.8	1.8	2.1
							15.0	28.6	80.4	1.7	1.9				
11/03/16	1317-1333	16/Cloudy	Small Wave	16.8	Surface	1.0	15.3	28.4	7.2	28.4	85.2	1.5	1.6	1.5	1.7
							15.2	28.3	85.6	1.5	1.7				
					Middle	8.4	15.3	28.4	7.1	28.4	84.3	1.5	1.5	1.5	2.1
							15.3	28.4	84.7	1.5	2.2				
					Bottom	15.8	15.2	28.4	7.1	28.4	84.3	1.6	1.6	1.6	2.1
							15.2	28.4	83.8	1.7	2.1				
14/03/16	1524-1542	16/Cloudy	Small Wave	16.8	Surface	1.0	17.1	28.1	8.4	28.1	103.0	2.0	2.4	2.0	2.6
							17.2	28.0	8.4	28.0	103.4	2.0	2.8		
					Middle	8.4	17.4	28.2	8.4	28.3	103.6	2.2	2.2	2.2	2.8
							17.3	28.3	8.3	28.3	102.7	2.2	3.1		
					Bottom	15.8	17.4	28.5	8.2	28.6	101.1	2.2	2.2	2.2	2.9
							17.5	28.6	8.2	28.6	101.6	2.3	2.7		
16/03/16	1752-1809	16/Cloudy	Small Wave	17.7	Surface	1.0	17.0	30.1	7.2	30.1	89.1	2.9	3.5	2.9	3.5
							17.0	30.0	7.2	30.0	89.5	2.9	3.5		
					Middle	8.9	17.1	30.2	7.3	30.2	90.2	2.2	2.1	2.1	2.7
							17.0	30.1	7.3	30.1	90.0	2.1	2.3		
					Bottom	16.7	16.8	30.2	7.2	30.2	88.7	3.9	3.8	3.8	4.8
							16.9	30.1	7.1	30.1	88.5	3.8	4.5		
18/03/16	0842-0855	18/Cloudy	Calm	16.2	Surface	1.0	17.4	30.2	6.9	30.4	86.9	2.1	2.7	2.1	2.7
							17.5	30.5	7.0	30.3	86.3	2.1	2.5		
					Middle	8.1	17.4	30.2	7.1	30.3	88.3	2.3	2.3	2.3	2.7
							17.4	30.3	7.2	30.3	89.5	2.3	2.7		
					Bottom	15.1	17.4	30.1	7.1	30.3	89.2	2.4	2.4	2.4	3.3
							17.4	30.4	7.1	30.4	89.6	2.5	3.0		

Mid-Ebb Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)				
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	
21/03/16	1045-1059	17/Cloudy	Small Wave	16.8	Surface	1.0	17.9	27.4	7.0	27.4	84.5	84.7	1.5	1.6	1.8	1.9	2.1		
							17.8	27.3	84.8		1.6		1.9						
					Middle	8.4	17.8	27.4	7.0	27.4	84.2	84.1	1.7	1.8	2.3	2.5		1.7	2.7
							17.8	27.4	84.0		1.8		2.7						
					Bottom	15.8	17.7	27.4	7.0	27.4	83.9	83.9	1.8	1.7	2.1	2.0		1.9	
							17.8	27.4	83.8		1.7		1.9						
23/03/16	1158-1215	18/Cloudy	Calm	16.4	Surface	1.0	17.8	29.7	7.0	29.6	87.6	88.0	2.8	2.8	3.1	3.3	3.6		
							17.7	29.5	88.4		2.7		3.5						
					Middle	8.2	17.8	30.0	7.0	30.4	87.7	88.4	2.7	2.7	3.5	3.5		2.8	3.5
							17.8	30.7	89.1		2.7		3.5						
					Bottom	15.4	17.7	30.1	7.1	30.0	88.4	87.9	3.0	3.0	3.8	3.9		3.0	3.8
							17.8	29.8	87.4		3.0		3.9						
30/03/16	1554-1612	18/Cloudy	Small Wave	16.2	Surface	1.0	17.9	29.5	6.8	29.6	86.0	85.5	2.7	2.8	3.5	3.4	3.6		
							17.8	29.6	84.9		2.8		3.3						
					Middle	8.1	17.8	29.9	7.1	29.9	89.0	89.4	2.9	2.9	3.7	3.8		2.8	3.8
							17.9	29.8	89.8		2.9		3.8						
					Bottom	15.2	18.1	29.9	7.1	30.0	89.8	90.2	2.8	2.7	3.9	3.7		2.8	3.7
							18.2	30.0	90.5		2.7		3.5						

Mid-Flood Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
02/03/16	1051-1105	15/Cloudy	Small Wave	15	Surface	1.0	15.5	28.1	7.2	28.1	85.4	2.0	3.2	2.2	3.2	2.9	
							15.5	28.1	7.2	85.0	2.1	3.0					
							15.4	28.2	7.0	83.5	2.2	2.4					
							15.4	28.1	7.0	83.2	2.1	2.6					
							15.1	28.5	6.9	81.7	2.4	2.8					
							15.1	28.4	6.9	81.3	2.3	3.0					
04/03/16	1250-1305	18/Fine	Small Wave	17.7	Surface	1.0	15.7	28.0	7.2	28.1	86.1	1.2	1.7	1.4	1.6	1.7	
							15.6	28.1	7.2	86.7	1.3	1.4					
							15.6	28.2	7.0	83.4	1.3	1.4					
							15.5	28.2	7.0	82.9	1.3	1.7					
							15.3	28.6	6.9	82.1	1.5	1.8					
							15.2	28.5	6.9	81.7	1.6	1.9					
07/03/16	1554-1612	16/Cloudy	Small Wave	17.8	Surface	1.0	15.5	27.5	6.9	27.6	86.6	1.3	2.0	1.4	1.9	1.9	
							15.6	27.6	6.9	86.3	1.3	1.7					
							15.8	27.6	6.8	85.6	1.3	1.6					
							15.7	27.7	6.8	85.7	1.3	1.7					
							15.5	28.0	6.6	83.6	1.7	2.0					
							15.4	27.9	6.7	84.0	1.6	2.1					
09/03/16	1654-1712	18/Cloudy	Small Wave	17.0	Surface	1.0	15.3	28.3	7.0	28.4	83.6	1.4	2.2	1.5	2.1	2.0	
							15.4	28.4	7.0	83.1	1.3	2.0					
							15.2	28.4	6.9	82.7	1.5	1.9					
							15.3	28.5	6.9	81.8	1.4	1.7					
							15.1	28.7	6.8	80.6	1.7	2.1					
							15.1	28.6	6.8	81.2	1.7	2.1					
11/03/16	0816-0830	17/Cloudy	Small Wave	17.0	Surface	1.0	15.4	28.4	7.1	28.5	84.7	1.5	1.8	1.6	1.8	1.9	
							15.3	28.5	7.1	85.0	1.5	1.8					
							15.3	28.5	7.1	84.6	1.5	1.7					
							15.4	28.4	7.1	84.3	1.6	2.1					
							15.4	28.4	7.1	84.4	1.8	1.9					
							15.2	28.4	7.1	84.5	1.8	2.0					
14/03/16	0924-0942	16/Cloudy	Small Wave	17.2	Surface	1.0	17.0	27.9	8.5	28.0	104.0	2.0	2.9	2.1	2.6	2.6	
							17.1	28.0	8.5	104.4	2.0	2.2					
							17.3	28.2	8.5	104.6	2.1	2.7					
							17.2	28.1	8.4	103.8	2.1	2.3					
							17.3	28.3	8.3	102.2	2.2	2.8					
							17.4	28.4	8.3	102.7	2.2	2.8					
16/03/16	1045-1100	15/Cloudy	Calm	16.1	Surface	1.0	16.5	30.3	7.9	30.5	98.4	1.7	2.4	2.3	2.4	3.0	
							16.8	30.6	7.9	98.6	1.7	2.4					
							16.8	30.3	7.8	97.2	1.9	2.1					
							16.9	30.5	7.8	97.4	1.9	2.3					
							16.9	30.4	7.9	98.5	3.3	4.0					
							16.9	30.7	7.9	98.8	3.4	4.7					
18/03/16	1323-1340	18/Cloudy	Calm	16.5	Surface	1.0	17.3	29.6	8.0	29.8	98.7	2.6	4.1	2.3	3.9	3.2	
							17.3	29.9	8.0	99.2	2.7	3.6					
							17.2	30.3	7.4	96.6	2.6	2.9					
							17.3	30.5	7.4	86.9	2.7	3.8					
							17.3	30.3	7.2	89.0	1.7	2.2					
							17.3	30.5	7.2	89.3	1.7	2.3					

Mid-Flood Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
21/03/16	1615-1629	18/Cloudy	Small Wave	17.2	Surface	17.8	27.3	27.3	7.0	84.2	1.5	2.3	1.6	2.0		
						17.9	27.3	84.7	1.6	1.7						
					Middle	17.8	27.4	84.1	1.7	2.2	1.7	2.2				
						17.9	27.3	83.6	1.7	2.2						
					Bottom	18.0	27.3	83.2	1.7	2.1	1.7	2.3				
						17.9	27.3	83.9	1.7	2.4						
23/03/16	1656-1701	18/Cloudy	Calm	16.6	Surface	17.9	29.5	29.4	6.9	84.9	2.4	3.3	2.4	3.3		
						18.0	29.3	83.9	2.5	3.3						
					Middle	17.9	29.8	7.2	90.8	2.8	3.3	2.9	3.7			
						17.9	29.7	7.7	92.7	3.0	4.1					
					Bottom	18.0	29.7	7.2	90.4	2.7	3.5	2.7	3.4			
						18.1	28.8	7.2	90.9	2.6	3.2					
30/03/16	0854-0912	18/Cloudy	Wave	16.6	Surface	17.7	29.6	29.7	7.1	88.1	2.7	3.5	2.8	3.3		
						17.6	29.7	89.0	2.8	3.1						
					Middle	17.6	30.5	7.1	88.6	2.6	3.7	2.6	3.7			
						17.7	30.6	7.2	90.2	2.6	3.7					
					Bottom	17.7	30.1	7.1	89.4	2.9	3.4	2.9	3.8			
						17.8	30.0	7.1	88.8	2.9	4.1					

Mid-Ebb Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average		
02/03/16	1830-1845	15/Cloudy	Small Wave	16	Surface	1.0	15.2	28.3	28.3	7.1	84.2	84.1	2.0	2.1	2.6	2.8			
							15.1	28.3	7.1	83.9	2.1	2.9							
							15.1	28.4	7.0	83.1	2.1	3.1							
04/03/16	0843-0858	18/Fine	Small Wave	16.0	Middle	8.0	15.1	28.4	28.4	7.0	82.7	82.9	2.1	2.1	3.0	3.1			
							14.9	28.5	6.9	81.5	2.4	3.6							
							15.0	28.5	6.9	81.1	2.4	2.8							
07/03/16	1118-1136	16/Cloudy	Small Wave	15.8	Surface	1.0	15.5	28.3	28.3	7.1	84.7	84.4	1.2	1.3	1.5	1.6			
							15.4	28.2	7.0	84.1	1.3	1.7							
							15.3	28.3	7.0	83.0	1.4	1.7							
09/03/16	1218-1236	18/Cloudy	Small Wave	15.6	Middle	7.9	15.2	28.4	28.4	6.6	82.5	82.8	1.4	1.4	1.6	1.7			
							15.5	27.7	6.6	82.9	1.4	1.6							
							15.2	28.4	6.5	81.4	1.5	1.9							
11/03/16	1335-1350	16/Cloudy	Small Wave	15.6	Surface	1.0	15.2	28.5	28.5	6.5	81.0	81.2	1.4	1.5	1.6	1.8			
							15.3	28.3	6.7	84.4	1.3	1.6							
							15.4	27.6	6.8	84.7	1.4	1.9							
14/03/16	1548-1606	16/Cloudy	Small Wave	19.2	Middle	7.8	15.4	27.8	27.8	6.6	83.3	83.1	1.5	1.4	2.2	2.0			
							15.5	27.7	6.6	82.9	1.4	1.8							
							15.2	28.3	6.5	81.7	1.5	2.2							
16/03/16	1813-1832	16/Cloudy	Small Wave	19.0	Surface	1.0	15.2	28.5	28.5	6.5	81.5	81.6	1.5	1.5	2.2	2.2			
							15.3	28.3	7.0	83.5	1.4	2.1							
							15.3	28.4	6.9	81.9	1.5	1.9							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Bottom	14.6	15.2	28.4	28.4	6.8	80.3	80.1	1.6	1.6	1.9	1.9			
							15.1	28.5	6.8	79.8	1.5	1.8							
							15.4	28.3	7.1	84.4	1.4	1.6							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Surface	1.0	15.3	28.3	28.3	7.1	84.8	84.6	1.4	1.4	1.6	1.7			
							15.3	28.4	7.1	84.8	1.4	1.8							
							15.3	28.4	7.0	84.0	1.4	2.1							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Middle	7.8	15.4	28.3	28.3	7.0	83.5	83.8	1.4	1.4	1.8	2.0			
							15.3	28.3	7.0	83.2	1.4	1.8							
							15.3	28.3	7.0	83.2	1.4	1.8							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Bottom	14.6	15.3	28.3	28.3	7.0	83.2	83.1	1.4	1.4	1.5	1.7			
							15.2	28.3	7.0	82.9	1.4	1.9							
							16.8	28.2	8.5	103.5	1.8	2.0							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Surface	1.0	16.8	28.2	28.3	8.5	103.7	103.7	1.8	1.8	2.3	2.3			
							16.9	28.3	8.5	103.8	1.8	2.5							
							17.1	28.5	8.4	103.2	1.8	2.6							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Middle	7.9	17.2	28.4	28.5	8.4	102.8	103.0	1.9	1.8	2.4	2.4			
							17.2	28.4	8.4	102.8	1.9	2.2							
							17.3	28.6	8.3	102.2	2.0	2.4							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Bottom	14.8	17.2	28.7	28.7	8.3	101.6	101.9	2.0	2.0	2.4	2.4			
							17.2	28.7	8.3	101.6	2.0	2.4							
							16.9	30.1	7.3	90.3	1.7	2.3							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Surface	1.0	17.0	30.1	30.1	7.4	90.6	90.5	1.7	1.7	2.2	2.2			
							16.8	30.2	7.4	91.5	1.9	2.1							
							16.9	30.3	7.4	91.4	1.9	2.5							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Middle	9.1	16.8	30.2	30.3	7.4	91.5	91.5	2.0	1.9	2.7	2.6			
							16.9	30.3	7.4	91.4	1.9	2.5							
							16.8	30.4	7.2	89.4	2.3	3.0							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Bottom	18.2	16.7	30.3	30.4	7.2	89.1	89.3	2.4	2.4	3.1	3.1			
							16.7	30.3	7.2	89.1	2.4	3.1							
							17.4	30.2	7.0	86.4	2.1	2.7							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Surface	1.0	17.4	30.2	30.5	7.0	87.1	87.1	2.1	2.1	2.6	2.6			
							17.4	30.8	7.0	87.7	2.1	2.5							
							17.4	30.2	7.1	87.6	1.9	2.1							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Middle	9.5	17.4	30.8	30.5	7.1	87.5	87.5	1.9	1.9	2.5	2.5			
							17.4	30.8	7.2	87.3	1.9	2.9							
							17.4	30.4	7.1	89.7	2.3	2.9							
18/03/16	0900-0915	18/Cloudy	Calm	19.0	Bottom	18.0	17.4	30.2	30.3	7.2	89.8	89.8	2.3	2.3	2.7	2.7			
							17.4	30.2	7.2	89.8	2.3	2.5							
							17.4	30.2	7.2	89.8	2.3	2.5							

Mid-Ebb Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/16	1100-1114	17/Cloudy	Small Wave	15.7	Surface	1.0	17.9	27.4	27.4	7.1	84.7	1.4	1.8	1.5	2.0	2.1	1.9	1.8
							17.8	27.4	27.4	7.0	84.2	1.4	2.1					
							17.9	27.3	27.4	7.0	83.6	1.5	2.0					
							17.9	27.4	27.4	6.9	83.2	1.5	2.1					
							17.8	27.4	27.4	6.9	82.7	1.6	1.9					
							17.8	27.4	27.4	6.9	83.0	1.5	1.8					
23/03/16	1220-1235	18/Cloudy	Calm	18.8	Surface	1.0	17.6	29.8	30.0	6.8	85.5	2.5	3.3	2.7	3.8	4.1	4.0	3.6
							17.8	30.1	30.0	7.0	87.3	2.6	3.9					
							17.8	29.9	30.2	6.9	88.3	2.7	3.5					
							17.7	30.4	30.4	7.0	88.8	2.7	4.1					
							17.6	30.1	29.9	7.0	87.7	2.9	4.0					
							17.7	29.6	29.6	7.0	87.3	2.8	3.6					
30/03/16	1618-1636	18/Cloudy	Small Wave	18.6	Surface	1.0	17.7	29.6	29.6	6.9	87.0	2.6	3.1	2.8	3.9	3.7	4.0	3.3
							17.8	29.5	29.6	6.9	86.4	2.6	3.3					
							17.7	29.7	29.8	6.9	86.6	2.9	4.0					
							17.7	29.8	29.8	7.0	87.4	2.9	3.7					
							17.8	29.9	30.0	7.0	88.7	3.0	4.0					
							17.9	30.0	30.0	7.0	88.5	3.0	3.3					

Mid-Flood Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen		Turbidity (NTU)		Suspended Solids (mg/L)		Depth-average
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Value	Average	Value	
02/03/16	1110-1127	15/Cloudy	Small Wave	16.4	Surface	1.0	15.4	28.0	28.0	7.2	85.9	1.9	2.5	2.4	1.9	2.1	2.5	2.7
					Middle	8.2	15.5	28.0	28.1	7.1	85.4	2.0	2.2					
					Bottom	15.4	15.4	28.1	28.1	7.1	84.5	2.1	2.4					
					Surface	1.0	15.2	28.3	28.4	7.0	83.2	2.4	3.1					
					Middle	8.2	15.6	28.1	28.1	7.2	85.5	1.2	1.6					
					Bottom	15.3	15.3	28.2	28.2	7.0	85.8	2.3	3.3					
04/03/16	1308-1324	18/Fine	Small Wave	16.3	Surface	1.0	15.5	28.2	28.2	7.2	83.7	1.3	1.5	1.6	1.2	1.3	1.5	1.6
					Middle	8.2	15.5	28.2	28.2	7.1	83.1	1.3	1.5					
					Bottom	15.3	15.4	28.3	28.4	7.0	84.1	1.4	1.9					
					Surface	1.0	15.3	28.4	28.4	7.0	83.3	1.4	1.7					
					Middle	8.2	15.7	27.7	27.8	6.8	85.6	1.2	1.5					
					Bottom	15.4	15.6	27.8	27.8	6.8	85.9	1.2	1.6					
07/03/16	1618-1636	16/Cloudy	Small Wave	16.4	Surface	1.0	15.5	27.9	27.9	6.7	84.5	1.4	1.6	1.6	1.4	1.3	1.5	1.7
					Middle	8.2	15.6	27.8	27.9	6.7	84.1	1.3	1.5					
					Bottom	15.4	15.4	27.9	28.0	6.6	82.9	1.5	1.9					
					Surface	1.0	15.3	28.0	28.0	6.6	82.7	1.4	1.8					
					Middle	8.2	15.4	28.5	28.5	7.1	84.3	1.3	1.5					
					Bottom	15.2	15.5	28.4	28.4	7.1	83.8	1.3	1.5					
09/03/16	1718-1736	18/Cloudy	Small Wave	16.2	Surface	1.0	15.3	28.5	28.5	7.0	82.7	1.4	1.7	1.7	1.4	1.4	1.7	1.7
					Middle	8.1	15.3	28.5	28.5	6.9	82.1	1.4	1.7					
					Bottom	15.2	15.3	28.6	28.7	6.8	81.1	1.5	1.7					
					Surface	1.0	15.2	28.7	28.7	6.8	80.5	1.5	2.0					
					Middle	8.1	15.3	28.5	28.5	7.1	84.6	1.4	1.9					
					Bottom	15.2	15.4	28.5	28.5	7.2	85.1	1.4	2.0					
11/03/16	0832-0845	15/Cloudy	Small Wave	15.8	Surface	1.0	15.4	28.5	28.5	7.1	84.4	1.3	1.6	1.7	1.3	1.4	1.6	1.8
					Middle	7.9	15.3	28.4	28.4	7.1	84.1	1.3	1.7					
					Bottom	14.8	15.3	28.5	28.5	6.9	82.9	1.4	1.8					
					Surface	1.0	15.3	28.5	28.5	7.1	82.1	1.4	1.8					
					Middle	8.1	16.8	28.1	28.2	8.6	104.5	1.7	2.2					
					Bottom	15.1	16.7	28.2	28.2	8.6	104.8	1.7	2.2					
14/03/16	0948-1006	16/Cloudy	Small Wave	16.1	Surface	1.0	16.8	28.3	28.4	8.5	103.2	1.8	2.3	2.2	1.7	1.8	2.1	2.4
					Middle	8.1	16.9	28.4	28.4	8.5	104.2	1.8	2.3					
					Bottom	15.1	17.1	28.6	28.6	8.4	103.2	2.0	2.8					
					Surface	1.0	17.0	28.5	28.6	8.4	102.6	1.9	2.7					
					Middle	8.1	16.8	30.2	30.3	7.6	96.8	1.8	2.5					
					Bottom	15.1	16.8	30.3	30.3	7.6	97.1	1.8	2.5					
16/03/16	1102-1115	15/Cloudy	Calm	19.1	Surface	1.0	16.7	30.1	30.2	8.0	98.1	2.1	2.3	2.3	2.1	1.9	2.3	2.3
					Middle	9.1	16.8	30.2	30.2	8.0	98.2	2.1	2.3					
					Bottom	18.1	16.8	30.2	30.3	8.1	98.8	1.8	2.0					
					Surface	1.0	16.8	30.4	30.4	8.1	99.2	1.8	2.2					
					Middle	9.1	17.8	30.1	30.2	7.3	91.4	2.0	2.4					
					Bottom	18.0	17.7	30.3	30.3	7.4	90.9	2.1	2.7					
18/03/16	1346-1402	18/Cloudy	Calm	19.0	Surface	1.0	17.4	30.2	30.2	7.7	92.9	1.5	1.8	1.9	1.5	1.7	1.9	2.2
					Middle	4.5	17.4	30.2	30.2	7.6	92.3	1.6	2.0					
					Bottom	18.0	17.3	30.4	30.3	6.7	85.3	1.5	2.2					
					Surface	1.0	17.4	30.2	30.3	6.7	85.7	1.6	2.0					
					Middle	4.5	17.4	30.2	30.2	6.7	85.3	1.5	2.2					
					Bottom	18.0	17.3	30.4	30.3	6.7	85.7	1.6	2.0					

Mid-Flood Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
21/03/16	1631-1645	18/Cloudy	Small Wave	16.0	Surface	1.0	17.8	27.4	27.4	7.0	84.0	1.4	1.4	1.6	1.7		
							17.9	27.4	83.8	1.4	1.8						
					Middle	8.0	17.9	27.4	27.4	7.0	83.5	1.5	1.5	1.9	2.0		
							17.8	27.3	83.6	1.5	2.0						
					Bottom	15.0	17.9	27.3	27.4	6.9	83.2	1.5	1.5	1.8	2.0		
							17.8	27.4	83.0	1.6	2.2						
23/03/16	1706-1721	18/Cloudy	Calm	19.0	Surface	1.0	18.0	29.5	29.2	7.0	88.2	2.7	2.7	3.0	3.0		
							17.8	28.9	87.6	2.7	2.9						
					Middle	8.5	17.7	29.7	29.5	7.0	86.8	3.0	3.1	3.5	3.9		
							17.9	29.3	88.2	3.2	4.1						
					Bottom	18.0	17.8	29.1	29.5	7.1	90.1	3.2	3.1	3.8	3.8		
							17.9	29.8	89.0	3.1	3.7						
30/03/16	0918-0936	18/Cloudy	Wave	19.0	Surface	1.0	17.5	29.9	30.0	6.9	86.0	2.4	2.5	3.2	3.1		
							17.6	30.0	86.7	2.5	3.0						
					Middle	9.5	17.7	30.3	30.4	7.0	87.8	2.6	2.6	3.6	3.5		
							17.6	30.4	88.6	2.7	3.4						
					Bottom	18.0	17.6	30.2	30.2	7.1	89.2	2.8	2.7	3.1	3.3		
							17.5	30.1	88.6	2.7	3.5						

Mid-Ebb Tide

Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average		
02/03/16	1850-1905	16/Cloudy	Small Wave	14.2	Surface	1.0	15.4	28.4	28.4	7.0	83.5	83.4	2.2	2.1	2.8	3.1			
					Middle	7.1	15.3	28.3	28.4	7.0	83.2	82.4	2.1	2.2	2.9				
					Bottom	13.2	15.2	28.4	28.4	6.9	82.5	82.2	2.3	2.2	3.3				
04/03/16	0901-0917	18/Fine	Small Wave	14.4	Surface	1.0	15.1	28.5	28.5	6.9	81.2	81.1	2.4	2.4	3.1	1.6			
					Middle	7.2	15.4	28.3	28.3	6.9	82.4	82.8	1.1	1.1	1.5				
					Bottom	13.4	15.3	28.4	28.4	6.9	81.7	81.9	1.2	1.2	1.4				
07/03/16	1142-1200	16/Cloudy	Small Wave	14.8	Surface	1.0	15.1	28.6	28.6	6.8	80.3	80.2	1.4	1.3	1.5	1.8			
					Middle	7.4	15.6	27.6	27.6	6.5	82.1	82.3	1.2	1.2	1.7				
					Bottom	13.8	15.5	27.7	27.7	6.5	81.5	81.4	1.3	1.3	1.8				
09/03/16	1242-1300	18/Cloudy	Small Wave	14.0	Surface	1.0	15.3	28.7	28.7	6.3	79.6	79.7	1.4	1.4	2.1	2.0			
					Middle	7.0	15.4	28.5	28.5	6.8	81.2	80.8	1.3	1.3	1.8				
					Bottom	13.0	15.0	28.7	28.7	6.7	79.2	79.1	1.5	1.5	1.9				
11/03/16	1351-1406	16/Cloudy	Small Wave	14.0	Surface	1.0	14.9	28.6	28.6	6.3	79.8	81.6	1.4	1.4	2.1	1.7			
					Middle	7.0	15.2	28.3	28.4	6.9	82.0	82.4	1.3	1.3	1.5				
					Bottom	13.0	15.3	28.4	28.4	6.8	81.0	80.8	1.4	1.3	1.6				
14/03/16	1612-1630	16/Cloudy	Small Wave	14.6	Surface	1.0	15.4	28.4	28.4	7.1	80.0	82.4	1.4	1.3	2.0	2.5			
					Middle	7.3	15.2	28.3	28.3	7.0	84.8	83.1	1.3	1.3	1.9				
					Bottom	13.6	15.3	28.3	28.4	6.9	82.3	82.5	1.4	1.4	1.5				
16/03/16	1835-1852	16/Cloudy	Small Wave	15.1	Surface	1.0	17.0	30.1	30.2	8.5	104.4	104.7	1.9	1.8	2.4	3.4			
					Middle	7.6	17.2	30.2	30.2	7.3	104.9	103.6	2.0	2.0	2.5				
					Bottom	14.1	17.3	30.5	30.3	7.2	103.2	102.9	2.1	2.1	2.6				
18/03/16	0921-0934	18/Cloudy	Calm	15.2	Surface	1.0	17.4	30.2	30.4	7.2	102.8	89.5	2.1	2.5	2.7	2.9			
					Middle	7.6	16.9	30.2	30.2	7.3	89.2	86.4	2.5	2.5	3.0				
					Bottom	14.2	16.8	30.1	30.3	7.3	88.6	87.2	2.6	2.6	3.0				

Mid-Ebb Tide

Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom	Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
21/03/16	1115-1129	17/Cloudy	Small Wave	14.2	Surface	1.0	17.8	27.3	6.9	27.4	83.2	1.3	2.0	1.4	2.1	1.9			
							17.9	27.4	83.8	1.4	2.1								
					Middle	7.1	17.9	27.4	6.9	27.4	82.3	1.4	1.6						
							17.8	27.4	82.4	1.4	1.5								
					Bottom	13.2	17.8	27.4	6.8	27.4	81.5	1.5	2.1						
							17.8	27.3	81.8	1.5	1.9								
23/03/16	1240-1253	18/Cloudy	Calm	15.1	Surface	1.0	17.8	29.8	6.9	29.9	87.5	3.0	4.1	3.0	4.2	4.1			
							17.8	29.9	86.7	3.0	4.3								
					Middle	7.6	17.7	29.3	7.0	29.7	87.2	2.7	4.0						
							17.8	30.0	88.0	2.6	3.9								
					Bottom	14.1	17.7	30.1	7.0	30.3	86.9	3.0	4.2						
							17.8	30.5	87.6	3.0	4.1								
30/03/16	1642-1700	18/Cloudy	Small Wave	15.0	Surface	1.0	17.8	29.4	6.8	29.5	85.1	2.6	3.9	2.6	3.8	3.8			
							17.8	29.5	86.1	2.6	3.6								
					Middle	7.5	18.0	29.7	6.9	28.7	86.6	2.5	3.5						
							18.1	27.6	87.6	2.4	3.1								
					Bottom	14.0	18.1	30.3	7.0	30.3	88.7	3.2	3.8						
							18.0	30.2	89.2	3.2	4.8								

Mid-Flood Tide

Monitoring Station : M5




Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)				
					Surface	Bottom	Value	Ave.	Value	Average	Value	Average	Value	Average	Value	Average	Value	Depth-average	Value
02/03/16	1135-1150	15/Cloudy	Small Wave	14.8	Surface	1.0	15.5	28.1	7.1	28.1	84.9	2.0	2.1	2.1	2.5	2.1	2.5		
					Middle	7.4	15.5	28.0	7.2	28.2	84.3	2.0	2.1	84.5	2.0	2.8	2.5	2.6	
					Bottom	13.8	15.3	28.1	7.0	28.2	83.1	2.1	2.1	83.3	2.1	2.5	2.5	2.5	2.6
					Surface	1.0	15.1	28.3	6.9	28.3	82.0	2.2	2.3	81.5	2.2	2.7	2.9	2.9	2.9
					Middle	7.4	15.2	28.3	6.9	28.3	81.5	2.3	2.3	81.5	2.3	3.0	2.9	2.9	2.9
					Bottom	14.8	15.5	26.0	7.1	27.1	84.1	1.0	1.0	84.0	1.0	1.4	1.5	1.5	1.5
04/03/16	1328-1344	18/Fine	Small Wave	14.8	Surface	1.0	15.6	28.1	7.1	28.1	83.8	1.1	1.1	1.5	1.5	1.5	1.5		
					Middle	7.4	15.4	28.1	6.9	28.1	82.5	1.2	1.1	82.3	1.2	1.5	1.5	1.5	
					Bottom	14.8	15.2	28.2	6.9	28.3	81.7	1.3	1.3	81.5	1.3	1.7	1.7	1.7	
					Surface	1.0	15.3	28.3	6.9	27.7	81.2	1.3	1.3	83.5	1.1	1.6	1.7	1.7	
					Middle	7.6	15.7	27.6	6.6	27.7	83.3	1.1	1.1	83.5	1.1	1.5	1.5	1.5	
					Bottom	14.2	15.4	28.0	6.4	28.0	80.8	1.3	1.3	80.9	1.3	1.6	1.6	1.6	
07/03/16	1612-1700	16/Cloudy	Small Wave	15.2	Surface	1.0	15.4	28.4	6.9	28.5	82.8	1.2	1.2	1.4	1.4	1.4	1.4		
					Middle	7.6	15.7	27.7	6.6	27.8	82.7	1.2	1.2	82.3	1.2	1.6	1.6	1.6	
					Bottom	14.2	15.5	28.0	6.4	28.0	81.0	1.3	1.3	80.9	1.3	1.6	1.6	1.6	
					Surface	1.0	15.4	28.5	6.9	28.5	82.0	1.1	1.1	82.4	1.2	1.4	1.4	1.4	
					Middle	7.1	15.4	28.5	6.9	28.6	81.8	1.3	1.3	81.3	1.2	1.3	1.5	1.5	
					Bottom	13.2	15.5	28.6	6.9	28.6	81.4	1.2	1.2	81.3	1.2	1.8	1.8	1.8	
09/03/16	1742-1800	18/Cloudy	Small Wave	14.2	Surface	1.0	15.1	28.7	6.7	28.8	80.0	1.4	1.4	1.8	1.8	1.8	1.8		
					Middle	7.1	15.2	28.8	6.7	28.8	79.7	1.3	1.3	79.9	1.3	1.8	1.8	1.8	
					Bottom	13.2	15.4	28.4	7.1	28.5	84.4	1.3	1.3	84.3	1.3	1.7	1.8	1.8	
					Surface	1.0	15.4	28.5	7.1	28.5	84.1	1.3	1.3	84.3	1.3	1.7	1.8	1.8	
					Middle	7.2	15.2	28.4	6.9	28.5	82.6	1.3	1.3	82.9	1.3	1.7	1.8	1.8	
					Bottom	13.4	15.3	28.5	7.0	28.5	83.1	1.3	1.3	82.9	1.3	1.8	1.8	1.8	
11/03/16	0846-0859	15/Cloudy	Small Wave	14.4	Surface	1.0	15.3	28.4	6.9	28.4	81.8	1.4	1.4	1.8	1.8	1.7	1.7		
					Middle	7.2	15.3	28.4	6.9	28.4	82.0	1.4	1.4	81.9	1.4	1.8	1.8	1.8	
					Bottom	13.4	15.4	28.4	6.9	28.4	82.0	1.5	1.5	81.9	1.5	1.8	1.7	1.7	
					Surface	1.0	16.8	28.3	8.6	28.3	105.4	1.8	1.8	105.7	1.8	2.2	2.1	2.1	
					Middle	7.4	16.9	28.2	8.7	28.3	105.9	1.8	1.8	105.9	1.8	2.2	2.1	2.1	
					Bottom	13.8	16.9	28.4	8.6	28.4	105.0	1.9	1.9	104.6	1.9	2.7	2.5	2.5	
14/03/16	1012-1030	16/Cloudy	Small Wave	14.8	Surface	1.0	16.8	28.3	8.4	28.8	104.0	2.0	2.0	2.2	2.2	2.3	2.3		
					Middle	7.4	17.1	28.7	8.4	28.8	104.0	2.1	2.1	104.0	2.0	2.2	2.3	2.3	
					Bottom	13.8	17.2	28.8	8.4	28.8	103.9	2.1	2.1	104.0	2.1	2.2	2.3	2.3	
					Surface	1.0	16.2	30.3	7.2	30.4	88.1	3.2	3.2	88.2	3.2	3.8	3.9	3.9	
					Middle	7.8	16.3	30.4	7.2	30.4	88.3	3.2	3.2	88.2	3.2	3.8	3.9	3.9	
					Bottom	14.5	16.7	30.2	7.3	30.2	87.1	2.1	2.1	87.2	2.0	2.8	2.7	2.7	
16/03/16	1113-1130	15/Cloudy	Calm	15.5	Surface	1.0	16.7	30.2	7.5	30.3	83.2	2.3	2.3	3.0	3.0	3.2	3.2		
					Middle	7.8	16.7	30.2	7.5	30.3	83.5	2.3	2.3	83.4	2.3	3.0	3.2	3.2	
					Bottom	14.5	16.7	30.4	7.5	30.4	83.5	2.3	2.3	83.4	2.3	3.0	3.2	3.2	
					Surface	1.0	17.4	30.2	7.3	30.3	91.8	1.8	1.8	91.3	1.8	2.0	2.3	2.3	
					Middle	7.8	17.6	30.4	7.3	30.3	92.0	2.0	2.0	91.3	2.0	2.5	2.3	2.3	
					Bottom	14.5	17.4	30.4	7.3	30.3	88.2	2.5	2.5	88.0	2.5	3.2	3.0	3.0	
18/03/16	1408-1423	18/Cloudy	Calm	15.8	Surface	1.0	17.5	30.3	7.2	30.3	89.7	1.9	1.9	2.3	2.3	2.4	2.4		
					Middle	7.9	17.5	30.3	7.2	30.3	89.7	1.9	1.9	89.5	1.9	2.3	2.4	2.4	
					Bottom	14.8	17.3	30.2	7.2	30.3	89.7	1.9	1.9	89.5	1.9	2.3	2.4	2.4	
					Surface	1.0	17.3	30.4	7.8	30.4	89.2	2.0	2.0	89.2	2.0	2.4	2.4	2.4	
					Middle	7.9	17.3	30.4	7.8	30.4	89.2	2.0	2.0	89.2	2.0	2.4	2.4	2.4	
					Bottom	14.8	17.3	30.4	7.8	30.4	89.2	2.0	2.0	89.2	2.0	2.4	2.4	2.4	

Mid-Flood Tide




Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)							
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average					
21/03/16	1646-1700	18/Cloudy	Small Wave	14.4	Surface	1.0	17.8	27.3	7.0	27.4	83.5	7.0	1.4	1.4	1.8	1.9	2.0	2.0					
							17.9	27.4	7.0		83.4		1.3		1.9								
					Middle	7.2	17.8	27.3	6.9	27.3	82.4	6.9	1.5	1.5	2.0	2.1			1.5	2.1	2.0	2.1	
							17.8	27.3	6.8		82.1		1.5		2.1								
					Bottom	13.4	17.8	27.4	6.8	27.4	81.6	6.8	1.5	1.6	2.0	2.0			1.6	1.9	1.9	2.0	2.0
							17.8	27.3	6.8		81.8		1.6		1.9								
23/03/16	1726-1741	18/Cloudy	Calm	15.6	Surface	1.0	17.8	28.9	6.9	29.2	86.1	6.9	2.7	2.8	3.8	3.7	3.8	3.8					
							17.9	29.4	6.9		86.9		2.9		3.7								
					Middle	7.8	17.9	29.6	7.0	29.5	86.8	7.0	2.4	2.5	3.4	3.5			2.8	3.4	3.5	3.8	
							18.0	29.3	7.0		87.8		2.6		3.6								
					Bottom	14.6	17.8	29.7	7.1	30.0	88.1	7.1	3.2	3.2	4.4	4.2			3.9	3.9	4.4	4.2	3.8
							17.8	30.2	7.1		88.9		3.2		4.4								
30/03/16	0942-1000	18/Cloudy	Wave	15.4	Surface	1.0	17.6	29.9	7.0	30.0	87.1	6.9	2.9	2.9	3.7	3.5	3.6	3.6					
							17.7	30.0	6.9		86.6		3.0		3.5								
					Middle	7.7	17.7	30.1	7.0	30.2	88.3	7.1	2.6	2.5	3.1	3.3			2.8	3.1	3.3	3.6	
							17.7	30.2	7.1		89.2		2.5		3.5								
					Bottom	14.4	17.8	30.4	7.1	30.5	89.3	7.1	2.9	2.9	4.0	3.9			2.9	2.9	3.8	3.9	3.6
							17.7	30.5	7.1		89.9		2.9		3.8								


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

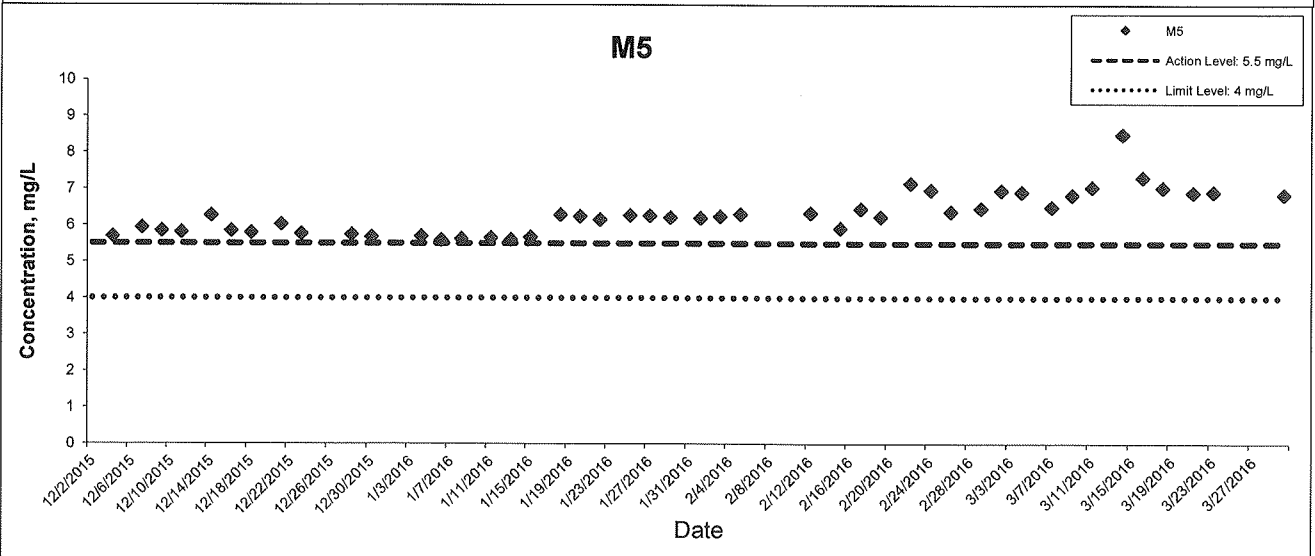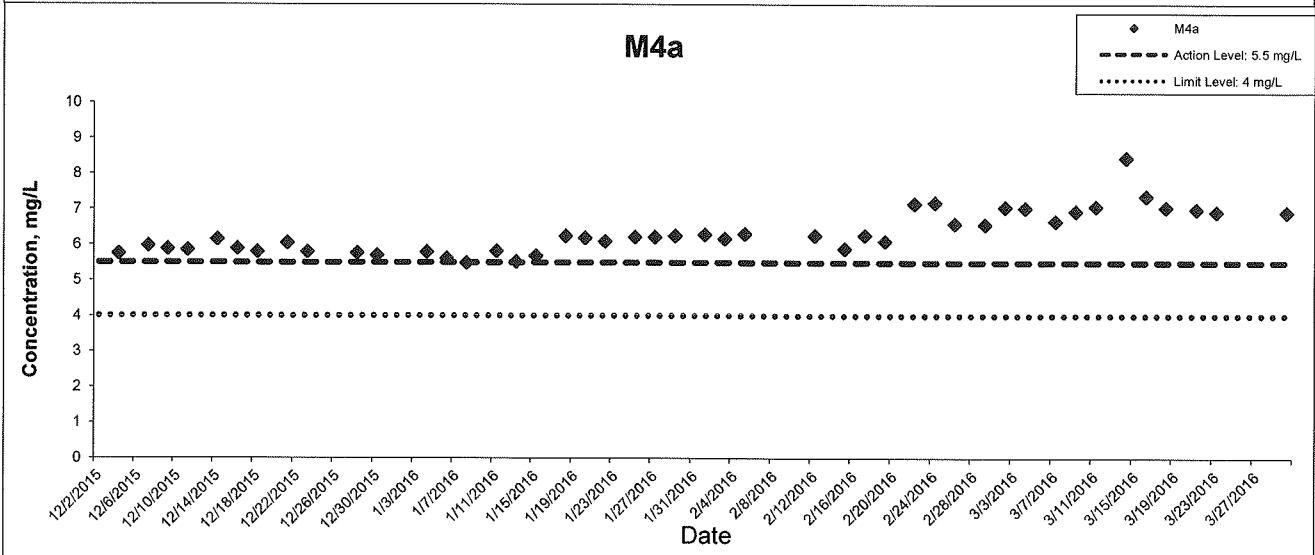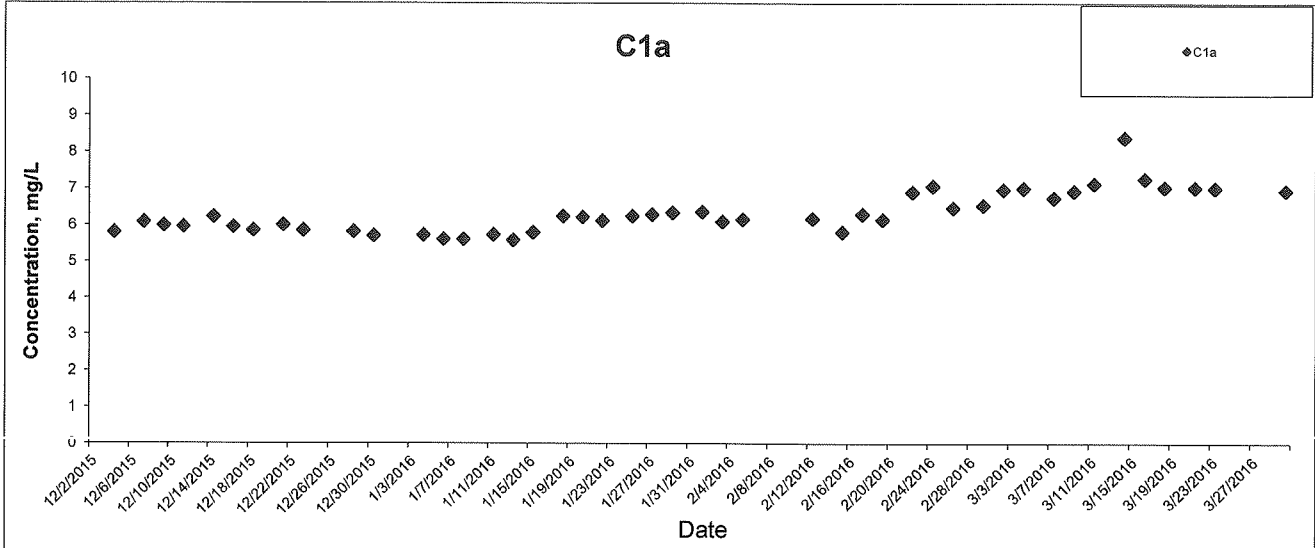


Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

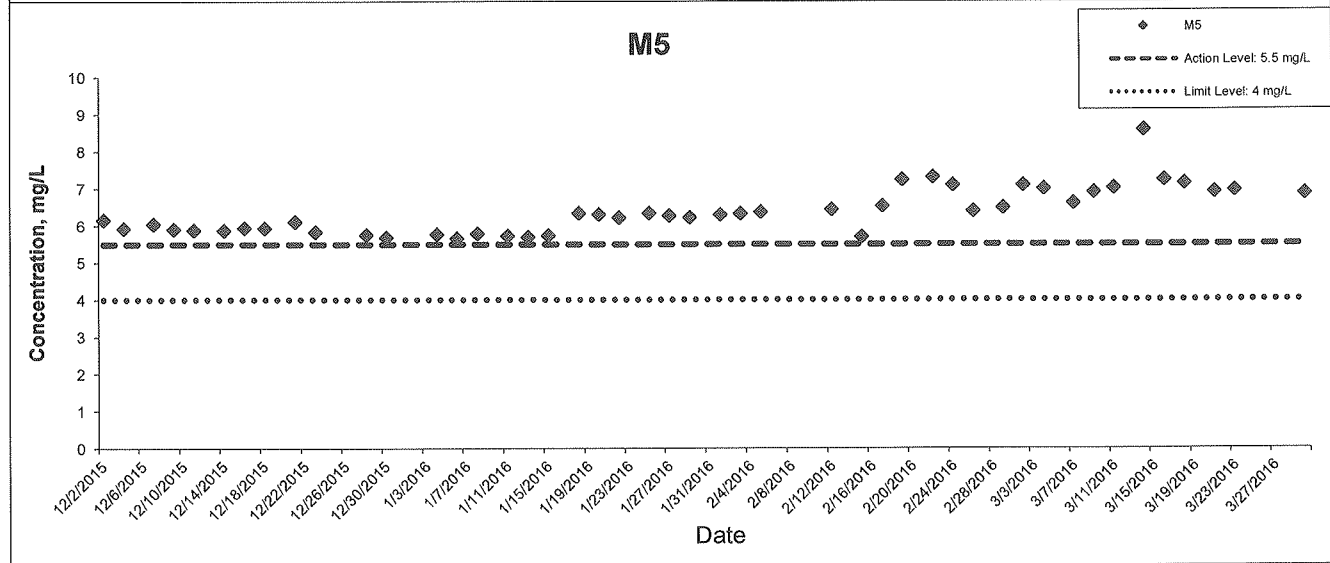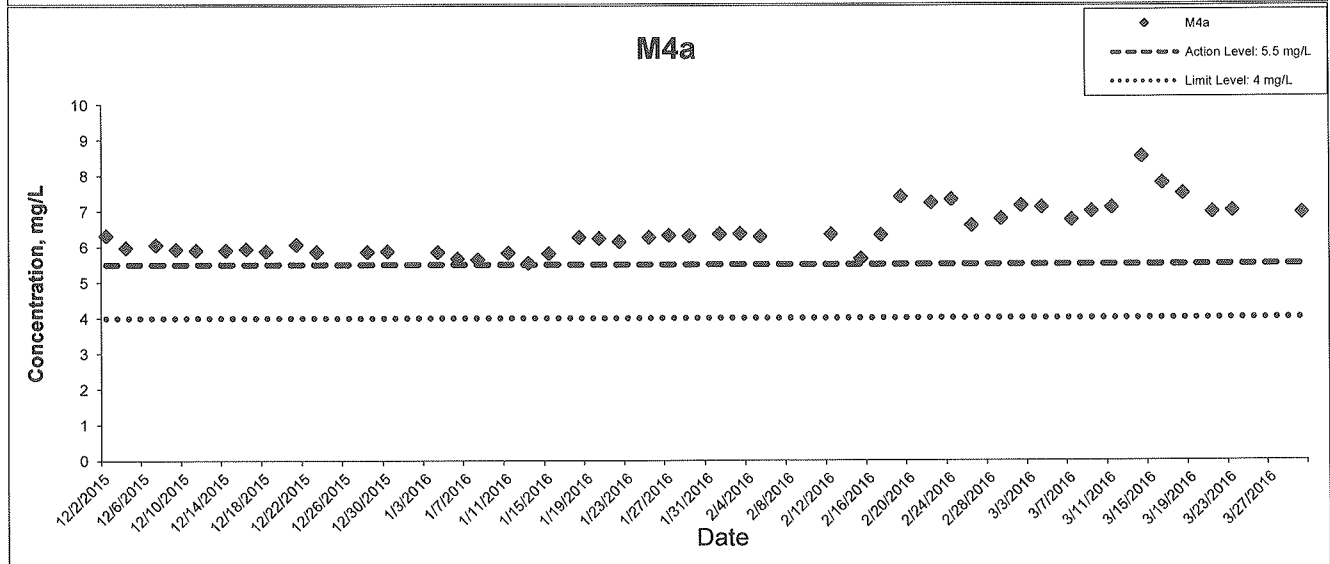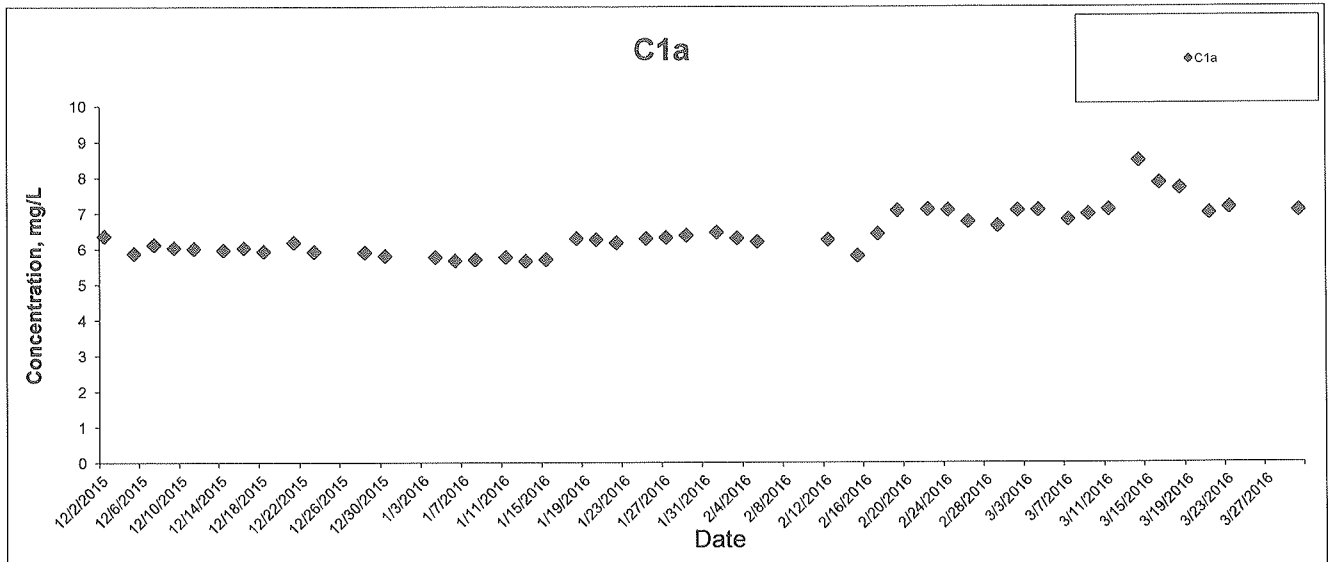




Dissolved Oxygen (Bottom) at Mid-Ebb Tide

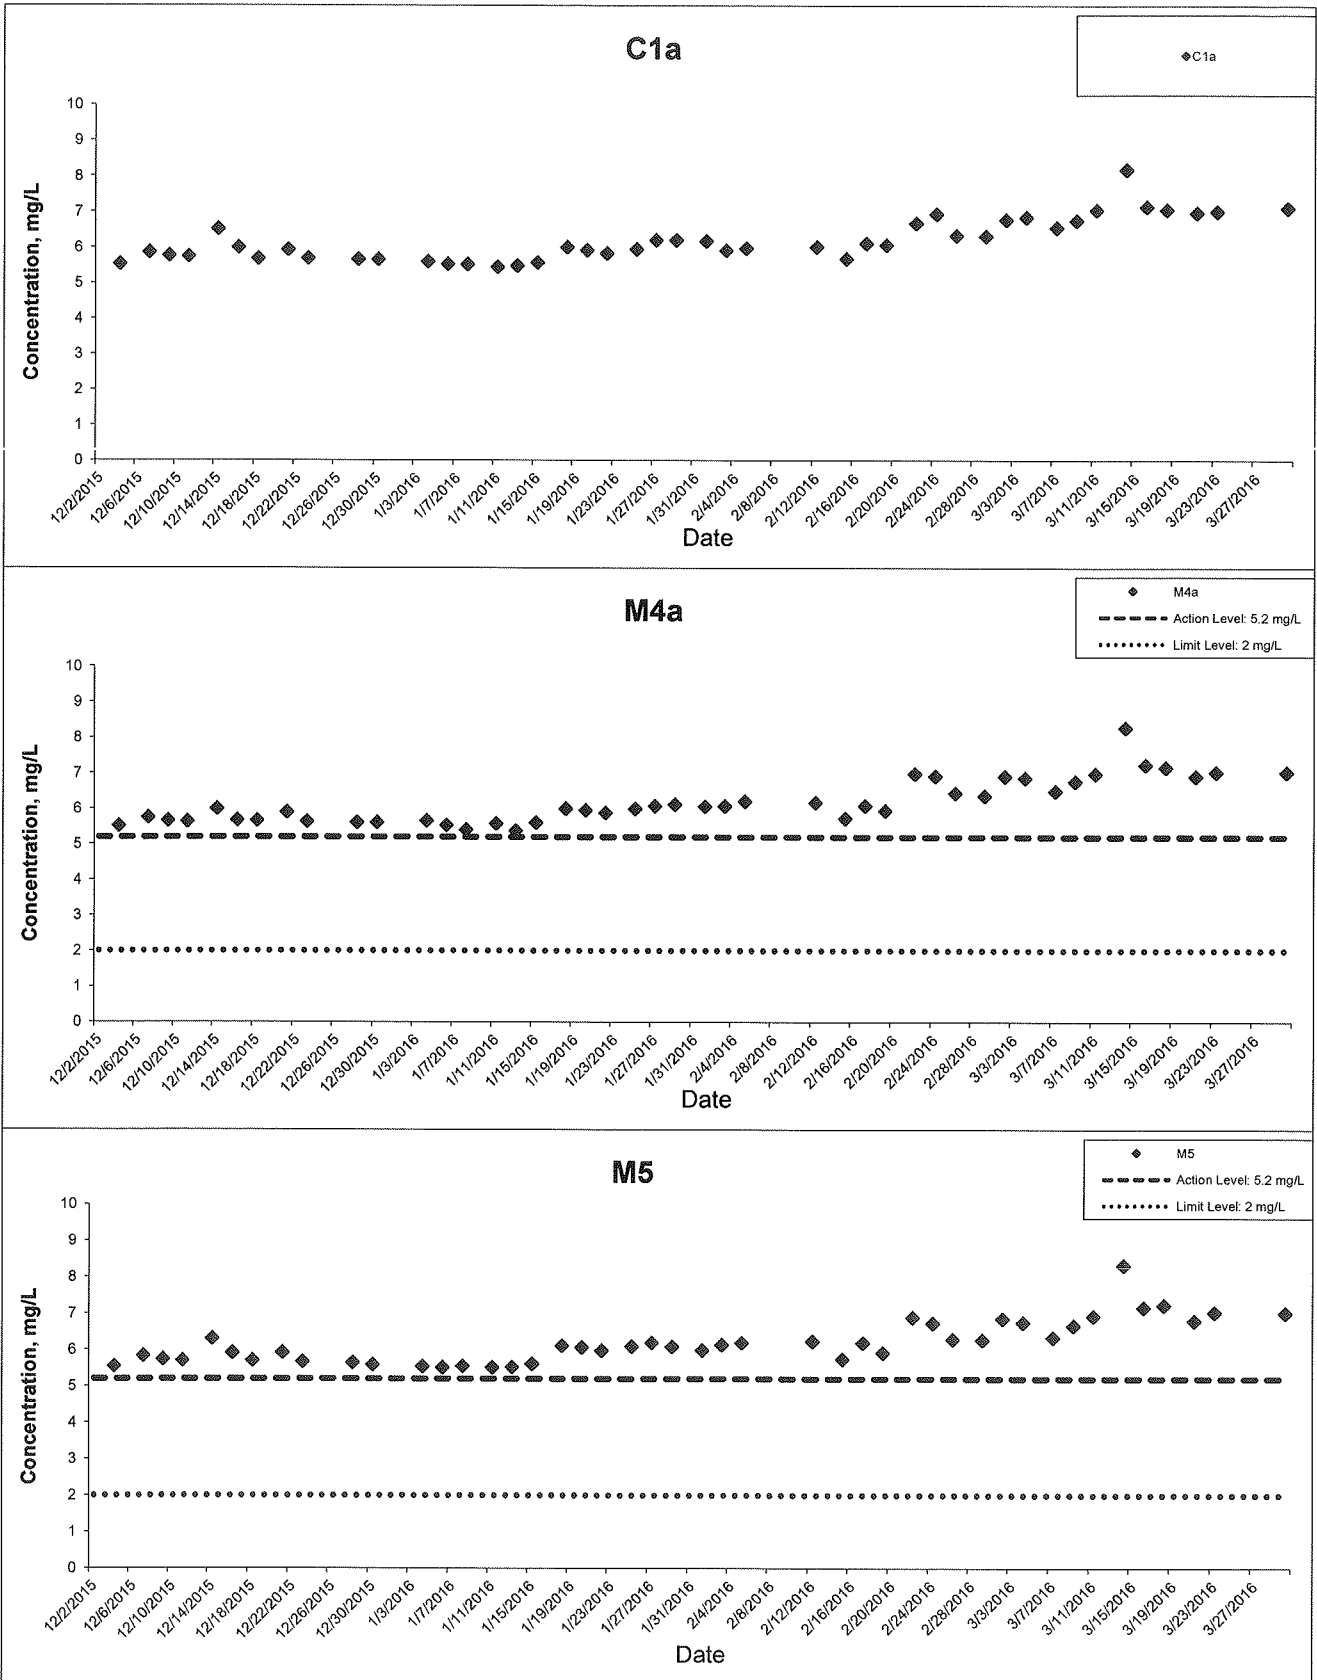




Dissolved Oxygen (Bottom) at Mid-Flood Tide

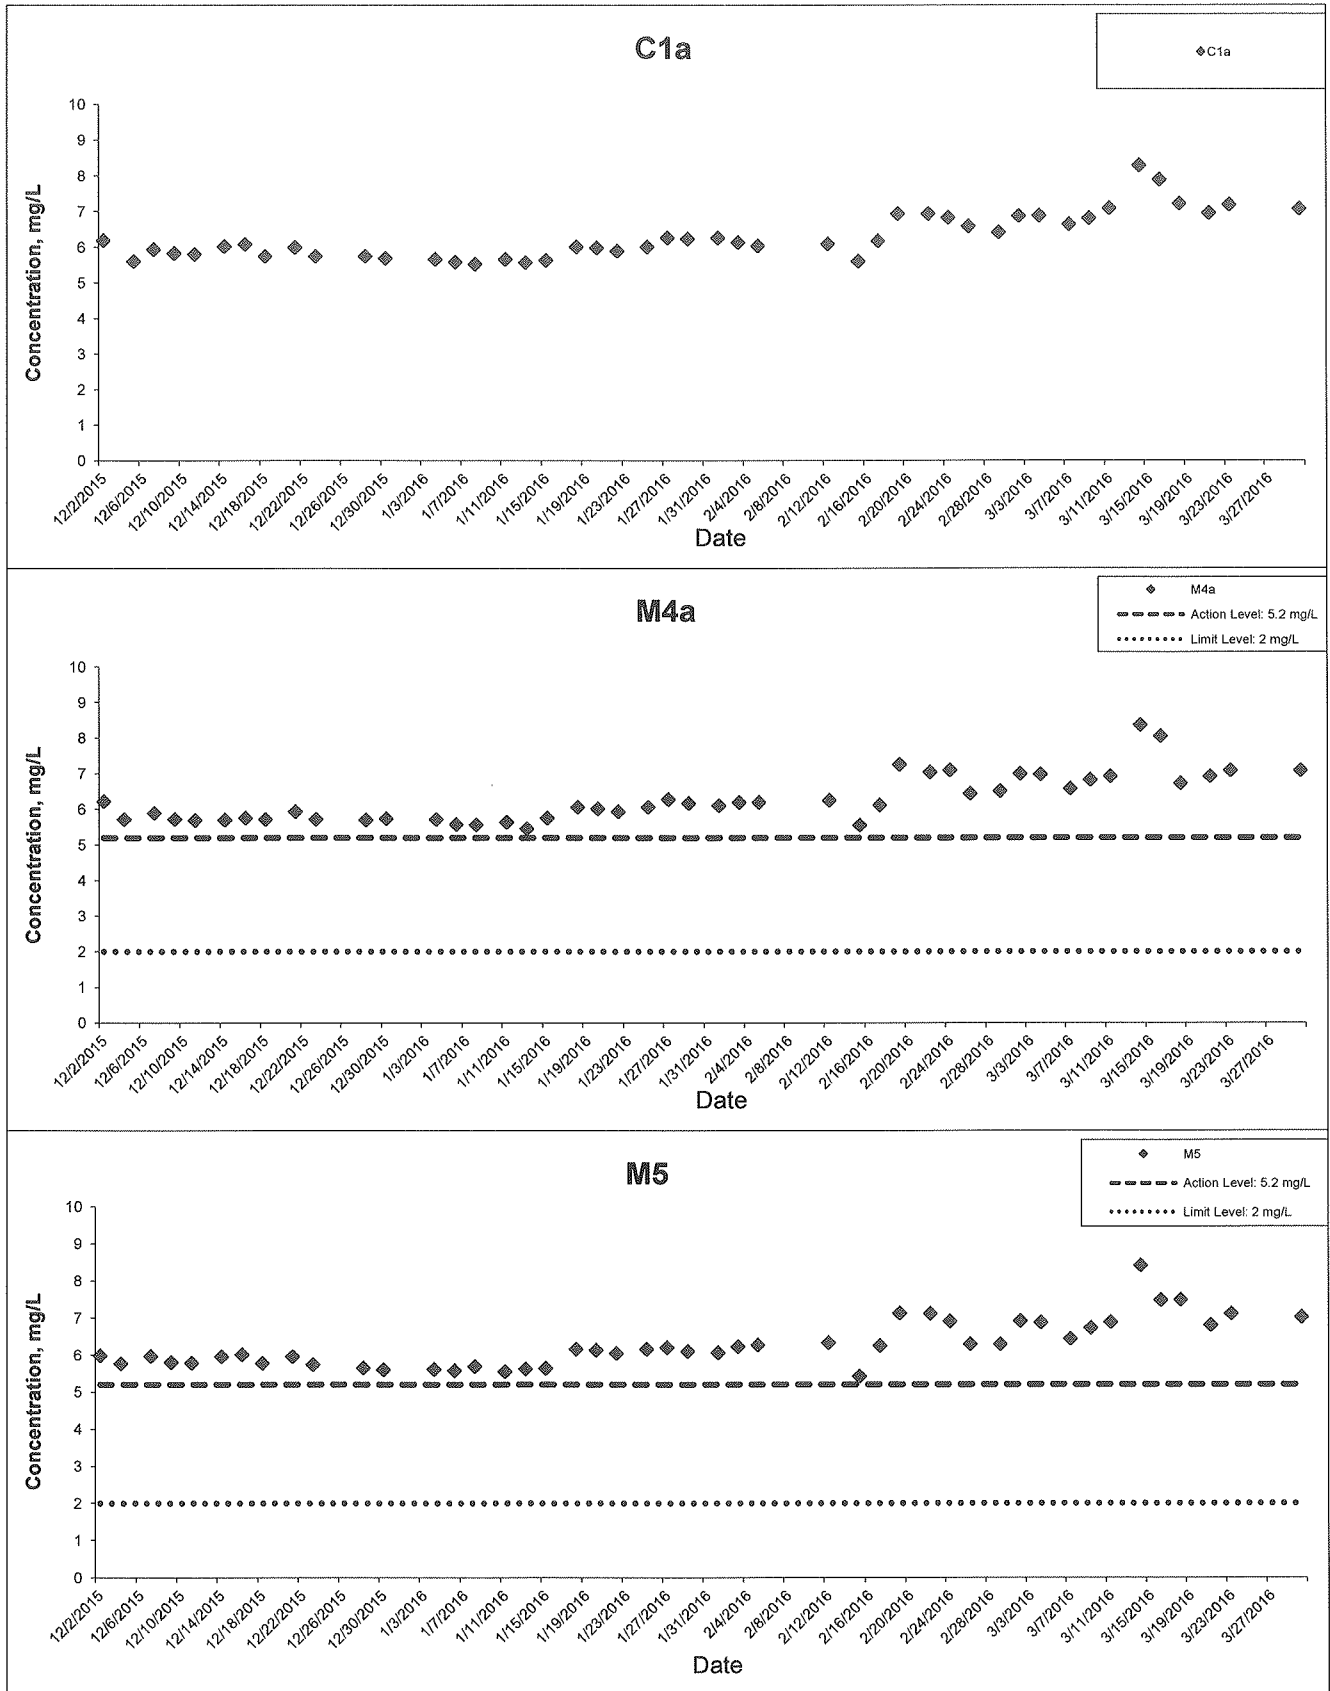


Turbidity at Mid-Ebb Tide

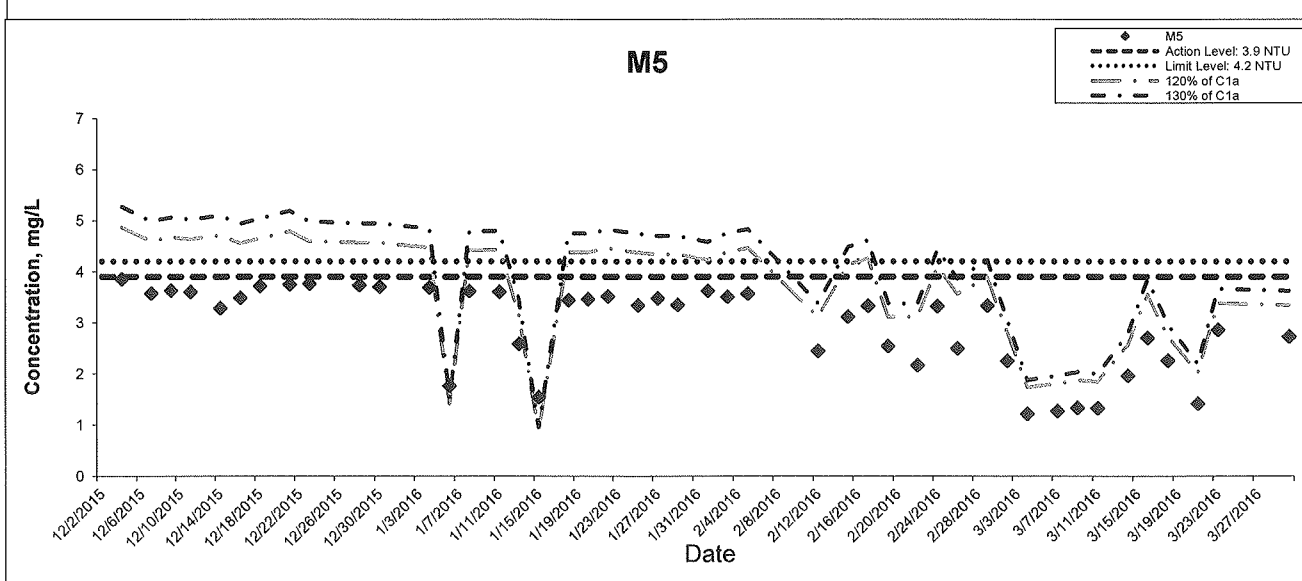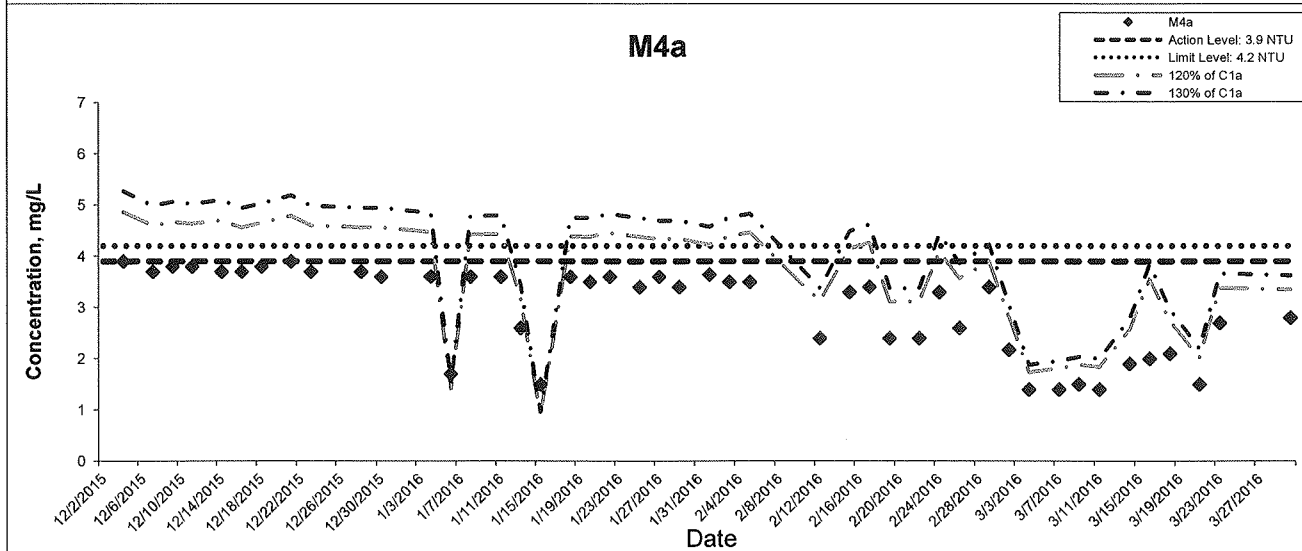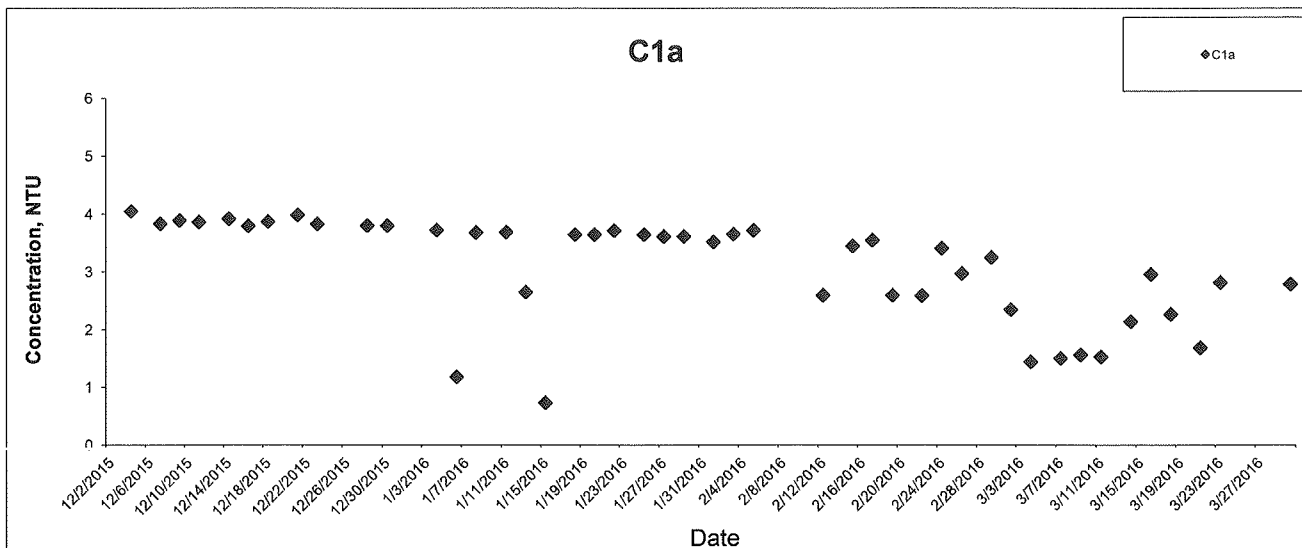




Turbidity at Mid-Flood Tide

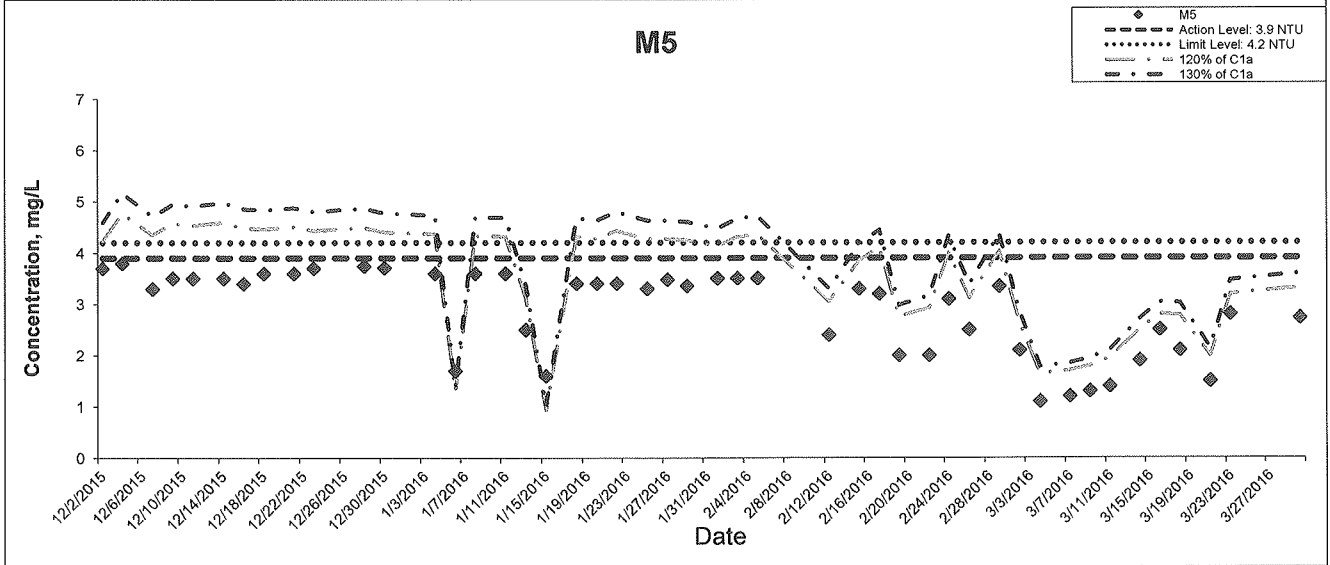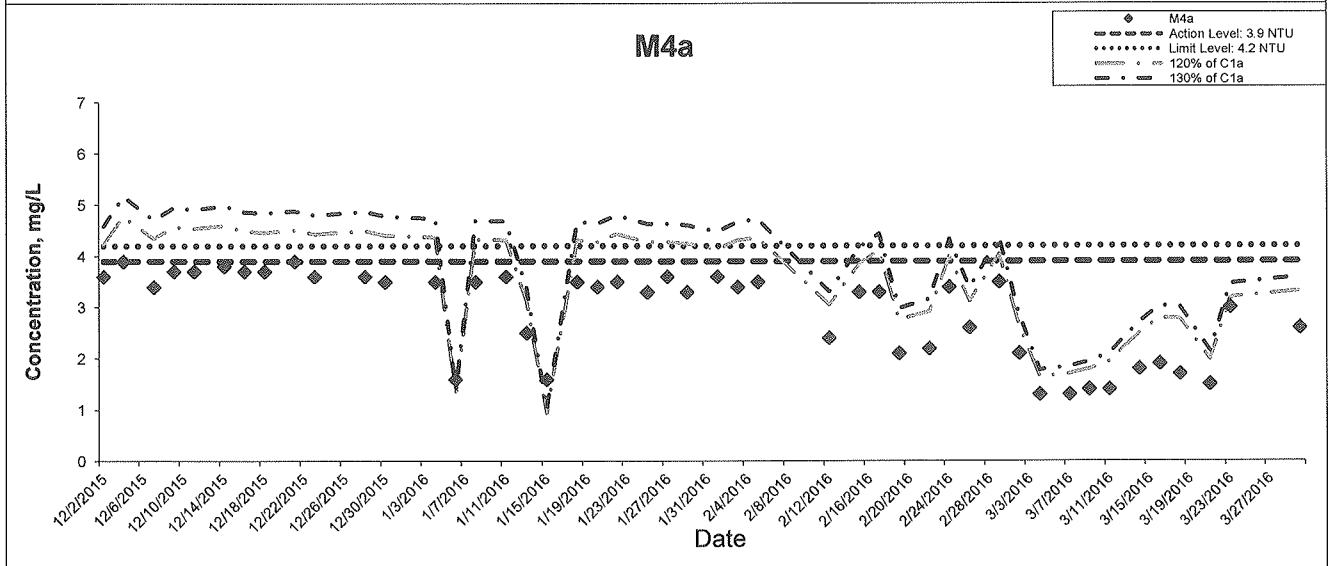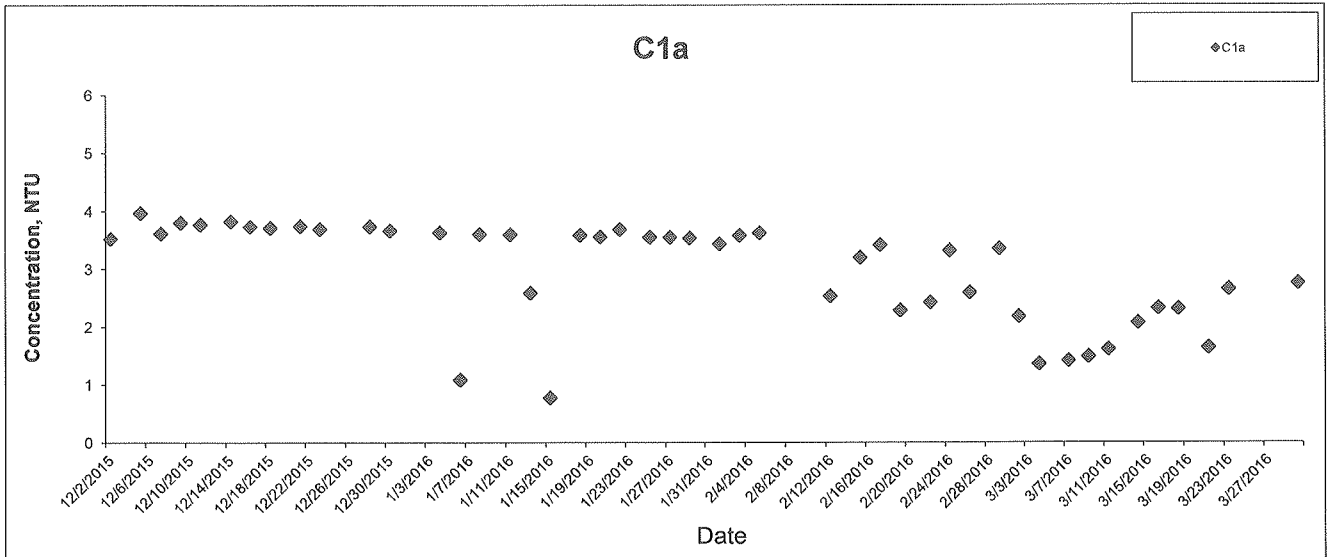

Suspended Solids at Mid-Ebb Tide

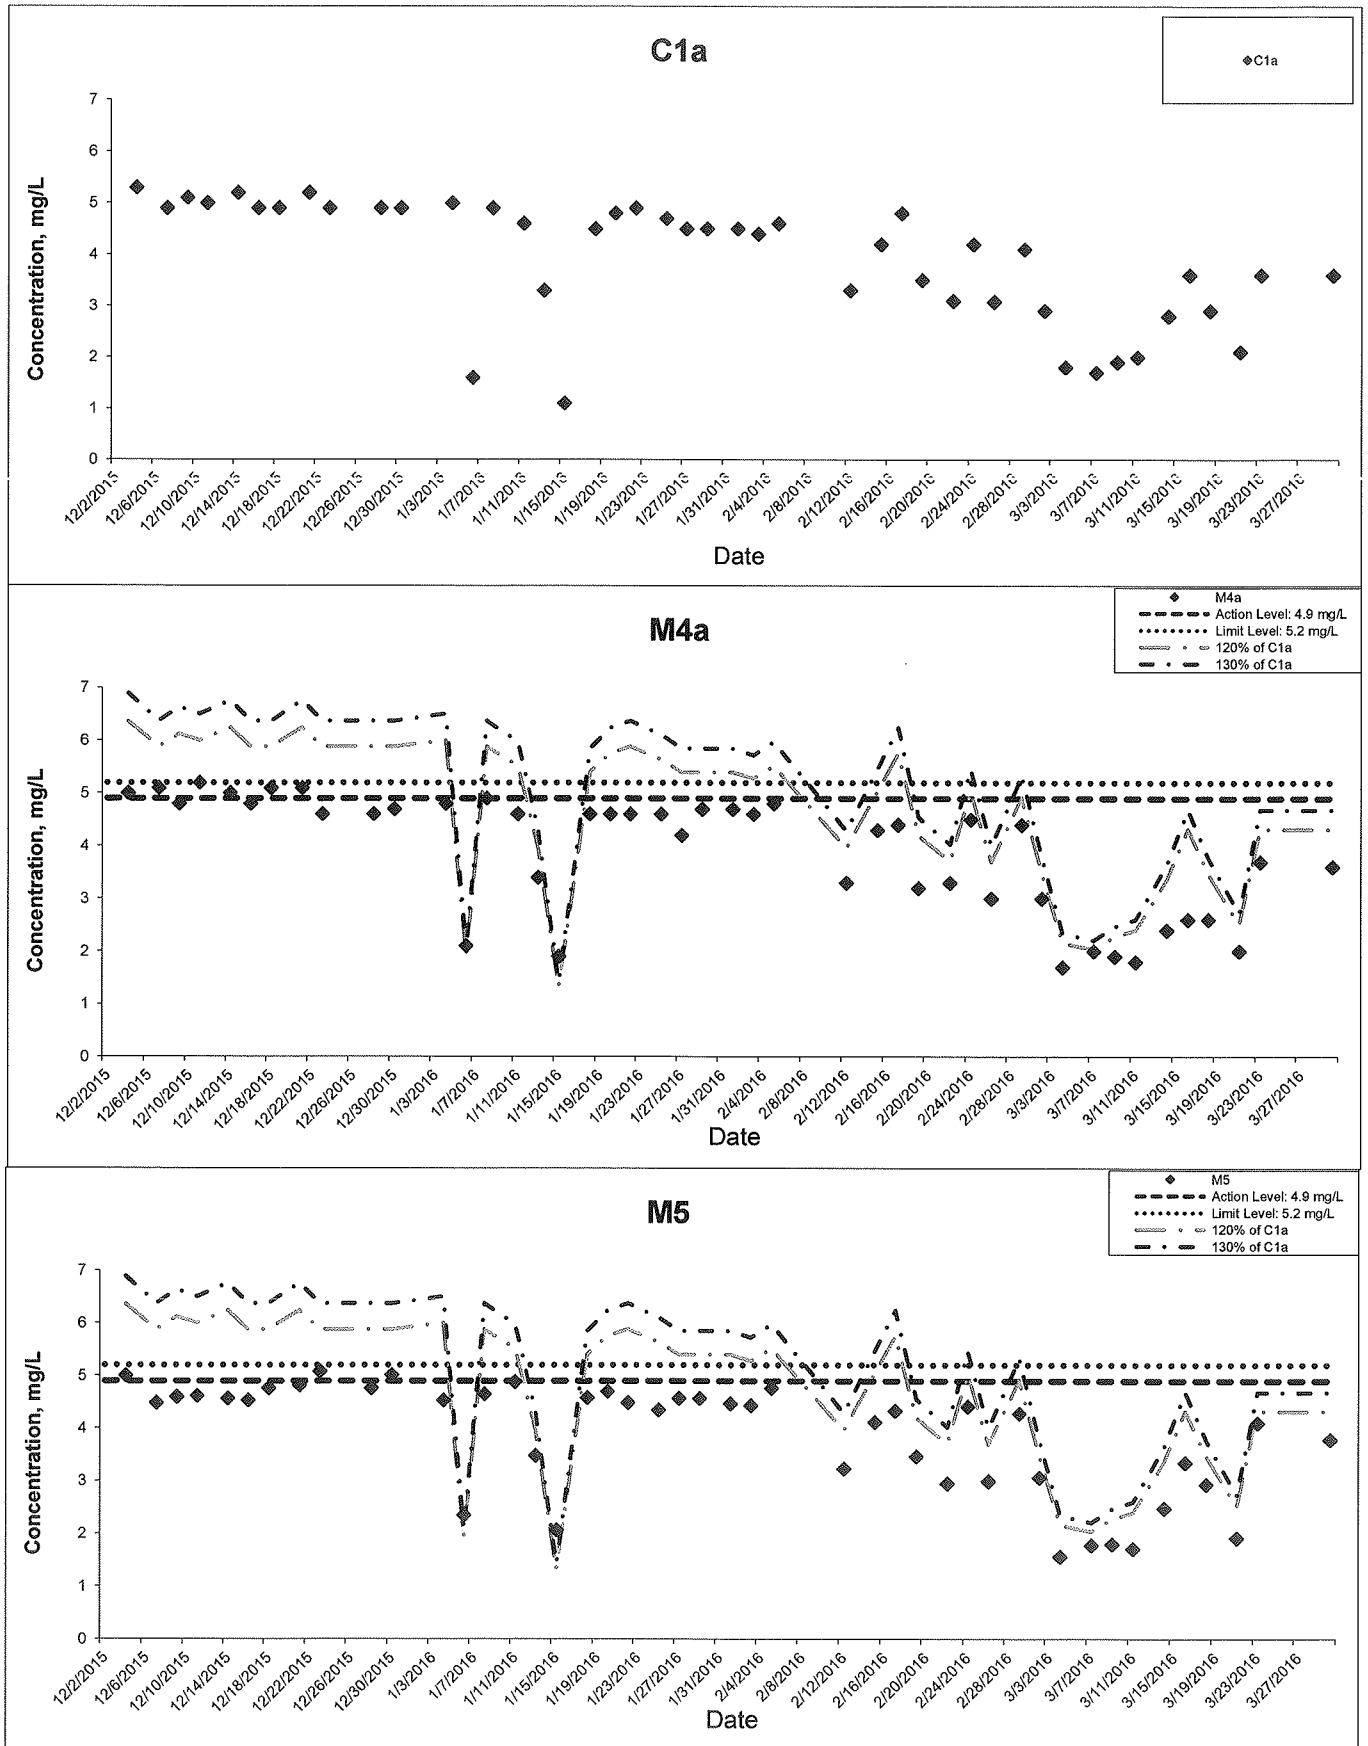

Suspended Solids at Mid-Flood Tide

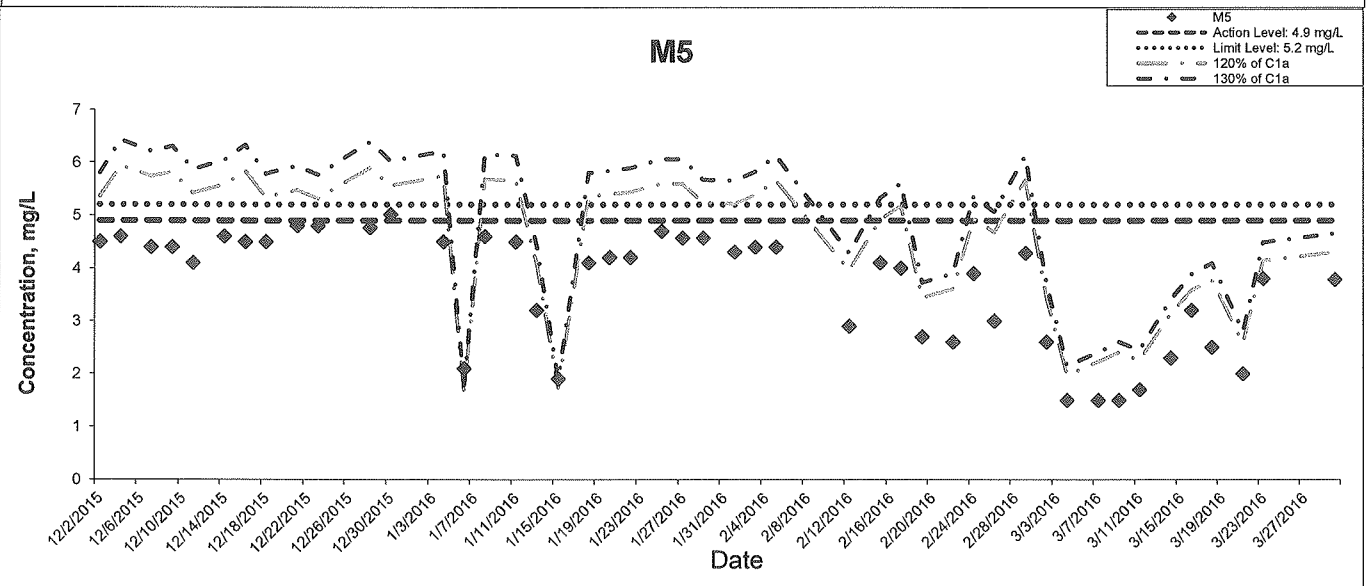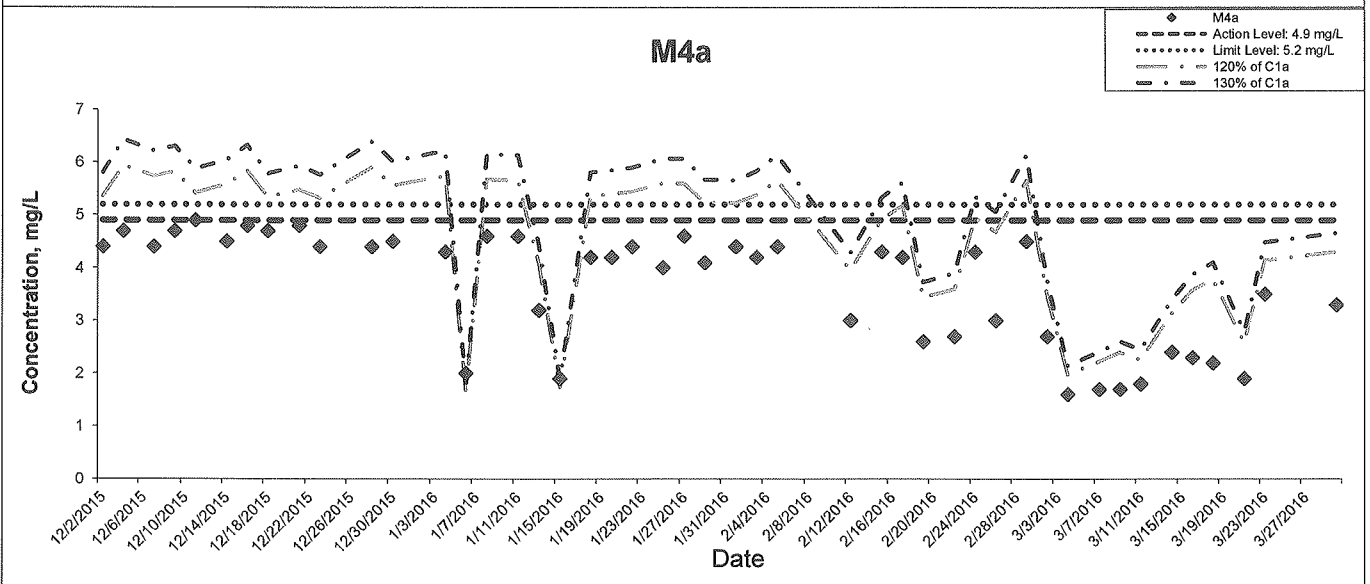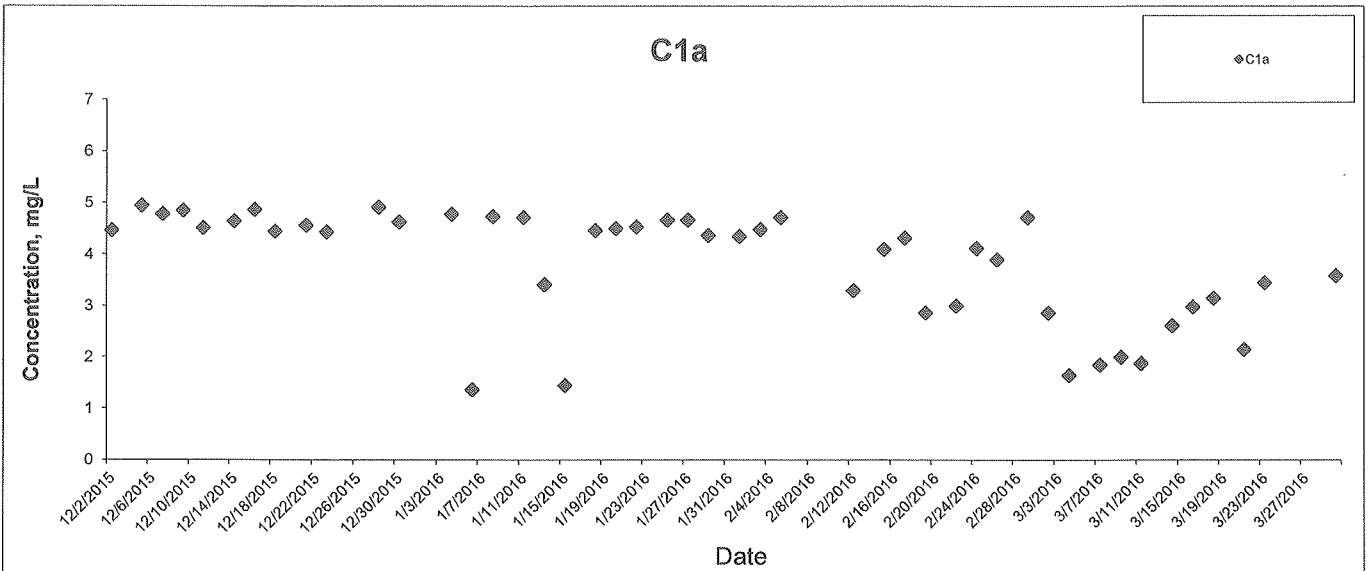

APPENDIX D
QA/QC REPORT

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/2/2016	99.5	FC1a-S1	6.06	EC1a-S2	107.4
	104.1	EC1a-M1	9.23	EWM5-B2	102.6

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/4/2016	105.2	FC1a-S1	0.00	EC1a-S2	102.9
	101.7	EC1a-M1	5.13	EWM5-B2	96.4

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/7/2016	96.9	FC1a-S1	9.52	EC1a-S2	101.5
	101.5	EC1a-M1	5.71	EWM5-B2	94.5

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/9/2016	99.6	FC1a-S1	8.70	EC1a-S2	105.9
	97.6	EC1a-M1	4.65	EWM5-B2	103.0

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/11/2016	106.3	FC1a-S1	5.41	EC1a-S2	101.0
	103.5	EC1a-M1	4.88	EWM5-B2	101.5

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/14/2016	107.3	FC1a-S1	3.39	EC1a-S2	93.2
	100.9	EC1a-M1	0	EWM5-B2	104.5

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/16/2016	104.2	FC1a-S1	0.00	EC1a-S2	102.1
	94.4	EC1a-M1	6.45	EWM5-B2	103.5

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/18/2016	96.8	FC1a-S1	4.76	EC1a-S2	101.6
	106.0	EC1a-M1	7.14	EWM5-B2	101.9

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.

(**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/21/2016	95.8	FC1a-S1	8.33	EC1a-S2	107.4
	101.5	EC1a-M1	0	EWM5-B2	102.1

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/23/2016	105.3	FC1a-S1	2.99	EC1a-S2	94.7
	103.6	EC1a-M1	0	EWM5-B2	94.1

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
3/30/2016	95.2	FC1a-S1	5.56	EC1a-S2	107.2
	105.0	EC1a-M1	2.67	EWM5-B2	106.3

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.