

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong

Tel : 2695 8318

E-mail : etl@ets-testconsult.com

Fax : 2695 3944

Web site : www.ets-testconsult.com

HKPFH Joint Venture

**Contract No.: CV/2013/06
Handling of Surplus Public Fill
(2014-2016)**

TSEUNG KWAN O AREA 137 FILL BANK

MONTHLY EM&A REPORT NO.29

(MAY 2016)

Prepared by:

LAW, Sau Yee
Senior Environmental Officer

Checked by:

LAU, Chi Leung
Environmental Team Leader

Issue Date: 29 July 2016

Report No.: ENA62138A
(Superseding Report No. ENA62138)

Ref.: CEDPFRSFEM01_0_0722L.16

9 August 2016

By E-mail and Fax No.: 2695 3944

ETS-Testconsult Limited
8/F, Block B
Veristrong Industrial Centre
34-36 Au Pui Wan Street
Fo Tan, Hong Kong

Attention: Mr. C L Lau

Dear Mr. Lau,

**Re: Contract No. CV/2013/06
Handling of Surplus Public Fill (2014 – 2016)
Monthly EM&A Report (No. 29) for May 2016 for the Tseung Kwan O Area 137
Fill Bank**

Reference is made to your submission of the revised Monthly EM&A Report for May 2016 for the TKO Area 137 Fill Bank received by E-mail on 30 July 2016, please be informed that we have no comment on the Monthly EM&A Report.

Thank you very much for your attention and please do not hesitate to contact our Jason Lai or the undersigned should you have any queries.

Yours sincerely,



Tony Cheng
Independent Environmental Checker

c.c.	CEDD	Attn: Mr. Terry Chock / Mr. Simon Leung	Fax No.: 2714 0113
	HKPFHJV	Attn: Mr. Eric Wan	Fax No.: 2744 6937

Q:\Projects\CEDPFRSFEM01\02 Project Management\02 Corr\CEDPFRSFEM01_0_0722L.16.doc



TABLE OF CONTENTS		Page
EXECUTIVE SUMMARY		
1.0	INTRODUCTION	1
2.0	PROJECT INFORMATION	
	2.1 Scope of the Project	1
	2.2 Site Description	1
	2.3 Work Programme	2
	2.4 Project Organization and Management Structure	2
	2.5 Contact Details of Key Personnel	2
3.0	WORK PROGRESS IN THIS REPORTING MONTH	2
4.0	AIR QUALITY MONITORING	
	4.1 Monitoring Requirement	2
	4.2 Monitoring Equipment	2
	4.3 Monitoring Parameters, Frequency and Duration	2
	4.4 Monitoring Locations and Schedule	3
	4.5 Monitoring Methodology	3
	4.6 Action and Limit levels	4
	4.7 Event-Action Plans	4
	4.8 Results and Observation	4
5.0	NOISE MONITORING	
	5.1 Monitoring Requirements	4
	5.2 Monitoring Equipment	4 – 5
	5.3 Monitoring Parameters, Duration and Frequency	5
	5.4 Monitoring Locations and Month	5
	5.5 Monitoring Procedures and Calibration Details	5
	5.6 Action and Limit levels	5
	5.7 Event-Action Plans	6
	5.8 Results and Observation	6
6.0	MARINE WATER QUALITY MONITORING	
	6.1 Monitoring Requirements	6
	6.2 Monitoring Locations	6
	6.3 Monitoring Parameters	6
	6.4 Monitoring Frequency	7
	6.5 Monitoring Methodology and Equipment Used	7 - 8
	6.6 Action and Limit Level	9
	6.7 Event and Action Plan	9
	6.8 Monitoring Duration and Month in this reporting month	9
	6.9 Marine Water Monitoring Results	9
7.0	ENVIRONMENTAL AUDIT	
	7.1 Weekly ET Site Inspections and EPD's Site Inspections	10
	7.2 Review of Environmental Monitoring Procedures	11
	7.3 Assessment of Environmental Monitoring Results	11
	7.4 Advice on the Solid and Liquid Waste Management Status	11 – 12
8.0	STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING	12
9.0	ENVIRONMENTAL NON-CONFORMANCE	
	9.1 Summary of air quality, noise and marine water quality	12
	9.2 Summary of Environmental Complaints	12
	9.3 Summary of Notification of Summons and Prosecution	12
10.0	IMPLEMENTATION STATUS	
	10.1 Implementation Status of Environmental Mitigation Measures	13
	10.2 Implementation Status of Event and Action Plan	13
	10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling	13
11.0	CONCLUSION AND RECOMMENDATIONS	13 – 14
12.0	FUTURE KEY ISSUE	
	12.1 Work Programme for the Coming Month	15
	12.2 Key Issues for the Coming Month	15 – 16
	12.3 Monitoring Schedule for the Coming Month	16



APPENDIX I

A	Organization Chart and Lines of Communication
B1	Calibration Certificates for Impact Air Quality Monitoring Equipment
B2	Impact Air Quality Monitoring Results
B3	Graphical Plots of Impact Air Quality Monitoring Data
C1	Calibration Certificates for Impact Noise Monitoring Equipment
C2	Impact Noise Monitoring Results
C3	Graphical Plots of Impact Noise Monitoring Data
D1	Calibration Certificates for Impact Marine Water Quality Monitoring Equipment
D2	Impact Marine Water Quality Monitoring Results
D3	Graphical Plots of Impact Marine Water Quality Monitoring Data
E	Weather Condition
F	Event-Action Plans
G	Work Programme
H	Weekly ET's Site Inspection Record
I	Implementation Schedule of Mitigation Measures
J	Site General Layout Plan
K	Monitoring Schedule for the Coming Month
L	Complaint Log
M	Complaint Investigation Reports in this Reporting Month

APPENDIX I FIGURES

Figure 1	Locations of Water Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank
Figure 2	Location of Noise Quality Monitoring Station – Tseung Kwan O Area 137 Fill Bank
Figure 3	Locations of Air Quality Monitoring Stations – Tseung Kwan O Area 137 Fill Bank

APPENDIX II

Marine Water Quality Monitoring Report for Contract No. HY/2010/02 Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing Facilities – Reclamation Works

TABLES

2.1	Contact Details of Key Personnel
4.1	Air Quality Monitoring Equipment
4.2	Monitoring parameters, duration and frequency of air quality monitoring
4.3	Air Quality Monitoring Locations
4.4	Action and Limit levels for 24-hr TSP and 1-hr TSP
5.1	Noise Monitoring Equipment
5.2	Duration, Frequency and Parameters of noise monitoring
5.3	Noise Monitoring Location
5.4	Action and Limit levels for noise monitoring
6.1	Locations of Marine Water Monitoring Stations
6.2	Marine Water Quality Monitoring Parameters
6.3	Monitoring frequency of the marine water
6.4	Summary of testing procedures
6.5	Details of Marine Water Quality Monitoring Equipment (In-site measurement)
6.6	Water Quality Action and Limit Levels
6.7	Time Schedule of Impact Marine Water Quality Monitoring
6.8	Summary of Impact Marine Water Quality Exceedances in this reporting month
7.1	Key Findings of Weekly ET Site Audits in this reporting month
7.2	Actual amounts of Waste generated in this reporting month
8.1	Summary of environmental licensing and permit status
10.1	Summary of Environmental Complaints and Prosecutions



EXECUTIVE SUMMARY

This monthly Environmental Monitoring and Audit (EM&A) report No.29 was prepared by ETS-Testconsult Ltd (ET) for the "Contract No: CV/2013/06 – Handling of Surplus Public Fill (2014-2016) – Tseung Kwan O (TKO) Area 137 Fill Bank" (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at TKO Area 137 in May 2016.

Site Activities

As informed by the Contractor, the site activities in this reporting month were as below:

1. Operation of the TKO137 Fill Bank.
2. Transferring public fill to vessel and delivering to Taishan and other parties
3. Repairing of silt curtain
4. Maintenance of tipping hall cladding

Environmental Monitoring Progress

The summary of the monitoring activities in this monitoring month is listed below:

- Noise Monitoring (Day-time): 1 Occasion at 1 designated location
- 24-hour TSP Monitoring: 5 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 14 Occasions at 2 designated locations
- Marine Water Quality Monitoring: 12 Occasions at 2 designated locations
- Weekly-site inspection: 4 Occasions

Noise Monitoring

No exceedance of Action and Limit levels for noise monitoring was recorded in the reporting month.

Air Monitoring

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting month.

Marine Water Quality Monitoring

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded in this reporting month.

Weekly Site Inspections

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting month. The major findings observed during site inspections are presented in the Section 7.0.

Environmental Complaints, Notification of summons and successful prosecutions

Seven complaints were received in this reporting month. Besides, no, notification of summons or successful prosecutions with respect to environmental issues was received in this month.

Future Key Issues

Based on site inspections and forecast of engineering works in coming month, key issues to be considered are as follows:

- Noise and air quality impact due to site works;
- Maintain wheel washing facilities properly;
- Maintain all drainage and desilting facilities properly;
- Use and maintain silt curtain properly;
- Clean up the fill material on concrete pavement along the BHA frequently;
- Sufficient drip trays for all oil drums / chemical containers;
- Implement all necessary preventive measures to avoid oil leakage. In the event an oil leakage happens, the Contractor should properly remove the leaked oil and handle the contaminated soil and all materials using for this cleaning works as chemical waste;
- Maintain good site practice and waste management to minimize environmental impacts at the site; and
- Follow-up improvements on waste management issues.



1.0 INTRODUCTION

HKPFH Joint Venture (HKPFH-JV) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the “Contract No: CV/2013/06 – Handling of Surplus Public Fill (2014-2016) – Tseung Kwan O (TKO) Area 137 Fill Bank” (The Project).

In accordance with the Environmental Permit (No.: EP-134/2002/K) (the EP), an EM&A programme should be implemented in accordance with the procedures and requirements in the EM&A Manual of the approved EIA report (Registration No. AEIAR-060/2002). The EM&A programme for this study as stated in Section 2.3.1 of the EM&A Manual covers the following environmental aspects during the establishment, operation and removal phases of the Fill Bank at Tseung Kwan O Area 137:

- *Fugitive Dust;*
- *Noise generation from onsite activities;*
- *Water Quality; and*
- *Landscape and Visual.*

The EM&A programme requires environmental monitoring for air quality, noise and water quality and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- *All monitoring parameters;*
- *Monitoring schedules for the reporting month and forthcoming months;*
- *Action and Limit levels for all environmental parameters;*
- *Event/Action Plans;*
- *Environmental mitigation measures, as recommended in the Project EIA study final report; and*
- *Environmental requirements in contract documents.*

Baseline monitoring was completed in August and September 2002 by Materialab. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 in May 2016.

2.0 PROJECT INFORMATION

2.1 Scope of the Project

The scale and scope of the Project as stated in the EP include:

- Site clearance;
- Construction of a temporary storm water system;
- Stockpiling of 6 million m³ of public fill;
- Setting up two barging points: one at the TKO Basin and one at the Construction and Demolition Material Sorting Facility (C&DMSF) for transporting the stockpiled public fill by barges;
- Setting up a temporary barging point at the existing Explosive Off-loading Barging Point located in the south-eastern part of Area 137 for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge;
- Construction and operation of a Construction and Demolition Material Sorting Facility (C&DMSF);
- Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin; and
- Remove the temporary fill bank.

2.2 Site Description

TKO Area 137 Fill Bank is located at the southern end of Wan Po Road. In the vicinity of the site are other industrial uses such as SENT landfill, TKO Industrial Estate, etc. Both Island Resort and Fullview Garden are also situated at more than 1.8km from the site. Other existing ASRs and NSRs, including resident developments and schools, are located at a further distance away from TKO Area 137.



2.3 Work Programme

Details of work programme are shown in Appendix I G.

2.4 Project Organization and Management Structure

The project organization chart is shown in Appendix I A.

2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

Table 2.1 Contact Details of Key Personnel

Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Simon Leung, Terry Chock, Patrick Ng, James Sze, Phoebe Tang	Engineer's Representative	2762 5555	2714 0113
IEC (Ramboll Environ)	Tony Cheng	IEC	3465 2888	3465 2899
Contractor (HKPFH-JV)	K W Li	Project Manager	9750 6438	2744 6937
ET (ETL)	C. L. Lau	ET Leader	2946 7791	2695 3944

3.0 WORK PROGRESS IN THIS REPORTING MONTH

As informed by the Contractor, the activities in the reporting month include:

1. Operation of the TKO137 Fill Bank.
2. Transferring public fill to vessel and delivering to Taishan and other parties
3. Repairing of silt curtain
4. Maintenance of tipping hall cladding

4.0 AIR QUALITY MONITORING

4.1 Monitoring Requirement

TSP levels were monitored in the reporting month in accordance with the EM&A Manual. Table 4.4 shows the Action and Limit Levels for the environmental monitoring works.

4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificates for the HVS and calibrator are attached in Appendix I B1.

Table 4.1 Air Quality Monitoring Equipment

Equipment	Model and Make
HVS	Greasby GMWS2310
Calibrator	Tisch TE-5025A

4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequency of air quality monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr	Once every six days
1-hr TSP	1 hr	Three times per day every six days



4.4 Monitoring Locations

Table 4.3 tabulates the air quality monitoring locations of this project.

Table 4.3 Air quality monitoring locations

<i>Monitoring station</i>	<i>Location</i>
<i>TKO-A1</i>	<i>Site Egress</i>
<i>TKO-A2a</i>	<i>CREO</i>

4.5 Monitoring Methodology

Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)

Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

Installation

The installation of HVS refers to the requirement stated in EM&A Manual.

Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 0.6m³/min and 1.7m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The flow rate was indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (Whatman G653) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling month of 1 hour or 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recorded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of 25°C ± 3°C and the relative humidity (RH) <50% ±5%.
- All measurement procedures in Section 2.3 of the EM&A Manual were followed during the reporting month.

Maintenance & Calibration

- HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

Wind Data Monitoring

Wind data (wind speed and wind direction) were directly extracted from Tseung Kwan O Station of Hong Kong Observatory. All wind data during this reporting month are shown in Appendix I E.



4.6 Action and Limit Levels

Table 4.4 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Table 4.4 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring Location	24-hr TSP ($\mu\text{g}/\text{m}^3$)		1-hr TSP ($\mu\text{g}/\text{m}^3$)	
	Action Level	Limit Level	Action Level	Limit Level
TKO-A1	210	260	376	500
TKO-A2a *	210	260	376	500

Remark (*): Since dust monitoring stations TKO-A2 and TKO-A2a are located close to the major dust emission sources and also close to the same sensitive receptor and no significant difference between them on the prevailing meteorological conditions, the baseline data from TKO-A2 (August and September 2002 by Materialab) can also be valid in the case of TKO-A2a.

4.7 Event-Action Plans

Please refer to Appendix I F for details.

4.8 Results and Observation

4.8.1 1-hour and 24-hour TSP Monitoring results

Monitoring data of both 1-hour and 24-hour TSP monitoring carried out in this reporting month are summarized in Appendix I B2. Graphical presentation of 1-hour and 24-hour TSP monitoring results for the reporting month is shown in Appendix I B3. Wind data included wind speed and wind direction was extracted from Tseung Kwan O Station of Hong Kong Observatory during this reporting month and is presented in Appendix I E.

No exceedance of Action and Limit Level of 1-hr TSP and 24-hour TSP monitoring results was recorded during the reporting month.

4.8.2 Observation

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of the mist spraying systems at the CEDD Combined Reception Office and the site egress area, wheel washing facilities, road dampening by water bowsers and automatic water sprinklers on the main haul roads. Furthermore, hydroseeded slopes on the stockpiling areas was maintained properly in order to prevent dust generation from wind erosion of the exposed surfaces. Other dust sources near TKO Area 137 also included operation of the temporary CWSF and dumping activities at the SENT Landfill.

5.0 Noise Monitoring

5.1 Monitoring Requirements

Noise monitoring was conducted at 1 monitoring station as specified in the approved EM&A Monitoring Proposal for good site practice. The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting month are presented in this section.

5.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level (L_{eq}) and percentile sound pressure level (L_x). It complies with International Electro Technical Commission Publications 651:1979 (Type1) and 804:1985 (Type1), and speed in m/s was used to monitor the wind speed.

Table 5.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix I C1.



Table 5.1 Noise Monitoring Equipment

Equipment	Model
Sound Level Meter	Rion NL-31 / Rion NL-52
Sound Level Calibrator	Rion NC-73 / Castle GA607

5.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 5.2.

Table 5.2 Duration, Frequencies and Parameters of Noise Monitoring

Time month	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	L_{eq} , L_{10} , L_{90}	Once per month

5.4 Monitoring Locations

One Noise monitoring was conducted at the noise monitoring location, TKO-N1 as shown in Figure 2 during the reporting month. Table 5.3 describes the location of the monitoring station.

Table 5.3 Noise Monitoring Location

Monitoring station	Location	Type of Measurement
TKO-N1	Outside site Egress along Wan Po Road	Free Field

5.5 Monitoring Procedures and Calibration Details

Operation/Analysis Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - Frequency weighting: A
 - Time weighting : Fast
 - Time measurement : 30 mins
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring month, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

5.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 5.4.

Table 5.4 Action and Limit Levels for noise monitoring

Time Month	Time Month	Action	Limit
Normal hours	0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)



5.7 Event-Action Plans

Please refer to the Appendix I F for details.

5.8 Results and Observation

5.8.1 Results

Only Day-time noise monitoring was carried out at monitoring station TKO-N1 in this reporting month. The detail of the noise monitoring is provided in Appendix I C2. Graphical presentation of the monitoring result for the reporting month is shown in Appendix I C3.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedances were recorded. Besides, no exceedances in Limit Level were recorded according to the result from Day-time monitoring.

5.8.2 Observation

The major noise source during the monitoring event was the dump truck traffic. Operation of the Fill Bank was from 08:00 to 21:00 from Monday to Sunday in the reporting month. Whereas the operation hours for barge activities in the TKO Basin was from 08:00 to 21:00. The monitoring result complied with the noise limit of 75dB(A).

6.0 MARINE WATER QUALITY MONITORING

6.1 Monitoring Requirements

In accordance with the EM&A Manual, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at Control Station, C1 and Monitoring Station, M4.

6.2 Monitoring Locations

For the Reclamation Project, there were 4 Designated Monitoring Stations and 2 Designated Control Stations specified in the EM&A Manual. Upon the completion of the monitoring programme under Stage 2 reclamation works, the ET started monitoring events at the impact station M4 and the control station C1 from 18 May 2004 onwards. Figure 1 shows the location of the marine water quality monitoring stations. Table 6.1 describes the locations of the monitoring stations in the reporting month.

Table 6.1 Locations of Marine Water Monitoring Stations

<i>Station Description</i>	<i>Code</i>	<i>HK Metric Grid E</i>	<i>HK Metric Grid N</i>
<i>Control Station (Ebb tide)</i>	<i>TKO-C1</i>	<i>844 740.208</i>	<i>815 371.502</i>
<i>Monitoring Station, Tung Lung Chau Fish Culture Zone</i>	<i>TKO-M4</i>	<i>847 741.029</i>	<i>812 977.878</i>

6.3 Monitoring Parameters

Monitoring of the marine water quality parameters are listed in Table 6.2.

Table 6.2 Marine Water Quality Monitoring Parameters

<i>In-situ measurement</i>	<i>Laboratory analysis</i>
<i>Depth (m)</i>	<i>Suspended solids (mg/L)</i>
<i>Temperature (°C)</i>	
<i>Dissolved Oxygen (mg/L and % saturation)</i>	
<i>Turbidity (NTU)</i>	
<i>Salinity (ppt)</i>	



6.4 Monitoring Frequency

The monitoring frequency of the marine water monitoring is summarized in Table 6.3.

Table 6.3 Monitoring frequency of the marine water

Parameter	Frequency	No. of Location	No. of Depths
Temperature	3 days/week, 2 tides/day	2 (TKO-C1 and TKO-M4)	3 (Surface, mid-depth & bottom)
Salinity			
DO			
Turbidity			
Suspended solids			

6.5 Monitoring Methodology and Equipment Used

For Location of the monitoring stations

Global Positioning System (GPS)

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

For Water Depth measurement

Echo Sounder

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently re-calibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.

Dissolved Oxygen, Salinity and Temperature Measuring Equipment

A portable, weatherproof dissolved oxygen & salinity measuring instrument, which complete with cable, sensor and DC power source (e.g. YSI 85 or equivalent) was used for measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200 % saturation;
- a salinity in range 0-40 ppt; and
- a temperature of 0-45 degree Celsius

A membrane electrode with automatic temperature compensation complete with a cable was installed.

Turbidity Measurement Instrument

A portable and weatherproof turbidity meter (HACH model 2100Q) was used during impact monitoring. It has a photoelectric sensor capable of measuring turbidity between 0-1000 NTU. Response of the sensor was checked with certified standard Turbidity solutions before the start of measurement.

For Water Sampling and Sample Analysis

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. If the water depth is less than 6 m, the mid-depth station shall be omitted and if the water depth is below 3 m, only the mid depth station shall be monitored.

Water Sampler

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.



Water Container

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labelled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 6.4.

Table 6.4 Summary of testing procedures

Laboratory Analysis	Testing Procedure	Detection Limit
Total suspended solids	In house method based on APHA 19 th ed 2540D	1.0 mg/L

In-situ measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before the start of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO, DOS and Salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required.

Table 6.5 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix I D1.

Table 6.5 Details of Marine Water Quality Monitoring Equipment (In-site measurement)

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	Garmin eTrex 10	-----	-----	ET/EW/005/04
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI 85	26/04/16	25/07/16	ET/EW/008/005 *
Turbidity	HACH Model 2100Q Turbid Meter	31/03/16	30/06/16	ET/0505/011 *
Water Depth	Speedtech SM-5	-----	-----	ET/EW/002/08

Remark: (*) indicates the instrument should be calibrated on use.

6.6 Action and Limit Level

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.



Table 6.6 Water Quality Action and Limit Levels

Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface & Middle</u> <5.45 mg/L (5%-ile of baseline data) <u>Bottom</u> <4.72 mg/L (5%-ile of baseline data)	<u>Surface & Middle</u> <5.10 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth-averaged)	>6.74 mg/L (95%-ile of baseline data) or >120% of the upstream control station's SS at the same tide on the same day	>7.67 mg/L (99%-ile of baseline data) or >130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth-averaged)	>4.28 NTU (95%-ile of baseline data) or >120% of the upstream control station's turbidity at the same tide on the same day	>4.58 NTU (99%-ile of baseline data) or >130% of the upstream control station's turbidity at the same tide on the same day

6.7 Event and Action Plan

Please refer to the Appendix I F for details.

6.8 Monitoring Duration and Month in this reporting month

Below is the time schedule for the marine water quality monitoring events that were conducted in this reporting month:

Table 6.7 Time Schedule of Impact Marine Water Quality Monitoring

May 2016						
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1	2	3	4	5	6	7
8	9	10	11	12	13	14
15	16	17	18	19	20	21
22	23	24	25	26	27	28
29	30	31				

Remarks: (▼) = Marine water quality monitoring carried out by ET.

(∇) = Marine water quality monitoring at 27 May 2016 (Flood Tide) was cancelled due to bad weather (Typhoon Signal No.3)

The daily marine water quality monitoring duration are detailed in Appendix I D2.

6.9 Marine Water Quality Monitoring Results

The impact water quality measurement results are detailed in Appendix I D2. Appendix I D3 presents the water quality monitoring data and graphical presentations of monitoring results respectively. The summary of marine water quality exceedances is shown in Table 6.8.

Table 6.8 Summary of Impact Marine Water Quality Exceedances in this reporting month

Station	Exceedance Level	DO		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
TKO-C1	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0
TKO-M4	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0

According to the summary of marine water monitoring results, no exceedance of Action and limit levels was recorded for this reporting month.



7.0 ENVIRONMENTAL AUDIT


7.1 Weekly ET Site Inspections and EPD's Site Inspections

7.1.1 Weekly ET Site Inspections

Weekly ET site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting month, four weekly site inspections were conducted (04, 11, 18 and 25 May 2016). Table 7.1 presents the key findings of weekly ET site inspection in this reporting month.

Table 7.1 Key Findings of Weekly ET Site Audits in this reporting month

Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor during the ET weekly site audit	Rectification Status by ET
04 May 2016	Stagnant water was found accumulated on the road near Zone A1. (Previous item)	To clean the stagnant water as soon as possible.	Stagnant water accumulated on the road near Zone A1 was cleared.	Closed
	Mud was noted on the ground near wheel maintenance area. (New item)	To clear the mud as soon as possible.	---	Follow-up
	Rubbish, such as plastic bag and paper box, were found discarded inside and beside the drainage channel near site entrance. (New item)	To collect and dispose of the rubbish properly.	---	Follow-up
11 May 2016	Mud was noted on the ground near wheel maintenance area. (Previous item)	To clear the mud as soon as possible.	Mud noted on the ground near wheel maintenance area was cleared.	Closed
	Rubbish, such as plastic bag and paper box, were found discarded inside and beside the drainage channel near site entrance. (Previous item)	To collect and dispose of the rubbish properly.	Rubbish, such as plastic bag and paper box, discarded inside and beside the drainage channel near site entrance was cleared.	Closed
	Muddy water was found accumulated besides the drainage channel near CP5. (New item)	To clear the accumulated muddy water properly.	---	Follow-up
	Some sand bags provided along the drainage channel near CP5 were broken. (New item)	To replace the broken sand bags by new ones.	---	Follow-up
18 May 2016	Muddy water was found accumulated besides the drainage channel near CP5. (Previous item)	To clear the accumulated muddy water properly.	Muddy water accumulated besides the drainage channel near CP5 was cleared.	Closed
	Some sand bags provided along the drainage channel near CP5 were broken. (Previous item)	To replace the broken sand bags by new ones.	Broken sand bags provided along the drainage channel near CP5 were replaced by new ones.	Closed
	The silt curtain near the tipping hall No.1 was found damaged. (New item)	To repair the damaged silt curtain properly.	---	Follow-up
25 May 2016	The silt curtain near the tipping hall No.1 was found damaged. (Previous item)	To repair the damaged silt curtain properly.	---	Follow-up
	Stagnant water was found under the container near wheel repairing area. (New item)	To clear the stagnant water to avoid mosquito breeding.	---	Follow-up



7.1.2 EPD's Site Inspections

Summary of EPD's site inspections in May 2016 is as below:

<i>Authorities</i>	<i>Date of inspection</i>	<i>Comment</i>	<i>Measures/Remarks</i>
EPD	17 May 2016 at TKOFB	Repairing of silt curtain and tipping hall No.3 cladding and spraying system.	Cladding and spraying system were fixed. Damaged silt curtain would be pending to repair on Mid of June.
	24 May 2016 at TKOFB	Ensure no muddy water discharge to the sea.	Complaint investigation for discharging muddy water
	30 May 2016 at TKOFB	Ensure no muddy water discharge to the sea and minimize fugitive dust during loading operation.	Complaint investigation for discharging muddy water and dust nuisance.

7.2 Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. The observations for the monitoring works were recorded and summarized as follows:

Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.

Noise Monitoring

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.

Water Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.

7.3 Assessment of Environmental Monitoring Results

All monitoring results were audited against the Action and Limit levels and any exceedance would be validated.

No exceedance was recorded in water quality, air quality and noise monitoring in this month.

The monitoring results in this reporting month were comparable with those of baseline month. Detailed discussions were given in Section 4, 5 and 6 of this Report.

7.4 Advice on the Solid and Liquid Waste Management Status

The Contractor usually disposed of non-inert waste, including general refuse and materials segregated from the existing stockpiles, to SENT landfill. Table 7.2 summarizes data on offsite waste disposal in this reporting month.

Table 7.2 Actual amounts of Waste generated in this reporting month

<i>Waste Type</i>	<i>Actual Amount</i>	<i>Disposal Locations</i>
<i>Public Fill (m³)</i>	0	TKO 137 Fill Bank
<i>C&D Waste (kg)</i>	0	SENT Landfill / Refuse Collection Point
<i>Chemical Waste (kg/L)</i>	0	Collected by licensed collector



The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.

Concrete bunding has erected outside the CEDD combined reception office and near the automatic wheel washing facilities for storing generator sets and oil drums. The drain outlet of all the bunded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal were properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank, DP3 and DP4 and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.


All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

8.0 Status of Environmental Licensing and Permitting

All permits/licenses valid in this reporting month are summarized in Table 8.1.

Table 8.1 Summary of environmental licensing and permit status

Description	Permit No.	Valid Month		Section
		From	To	
Amended Environmental Permit	EP-134/2002/K	04/02/13	----	<ul style="list-style-type: none"> ▪ Site clearance ▪ Construction of a temporary storm water system ▪ Stockpiling of 6 million m3 of public fill ▪ Setting up two barging points for transporting the stockpiled public fill by barges ▪ Setting up a temporary barging point at the existing Explosive Off-loading Barging Point for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge ▪ Construction of operation of a construction and Demolition Material Sorting Facility (C&DMSF) ▪ Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin ▪ Remove the temporary fill bank
Effluent Discharge License	WT000188 97-2014	11/07/14	31/07/19	<ul style="list-style-type: none"> ▪ Wastewater arising from the wheel washing bay of the premises, Sedimentation Tank & Desilting Tank
Marine Dumping Permit	EP/MD/16-193	01/04/16	30/06/16	<ul style="list-style-type: none"> ▪ Approval for dumping 4,400,000 tons (approximately equal to 2,444,444 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan
Chemical Waste Producer	5213-839-H3552-01	21/01/14	----	<ul style="list-style-type: none"> ▪ Spent Lubricating Oil and Spent Battery
Billing Account for Waste Disposal	7018998	----	----	<ul style="list-style-type: none"> ▪ ----



9.0 ENVIRONMENTAL NON-CONFORMANCE

9.1 Summary of air quality, noise and marine water quality

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

9.2 Summary of Environmental Complaints

Seven complaints were received in this reporting month.

9.3 Summary of Notification of Summons and successful Prosecution

There was no notification of summons and successful prosecution respect to environmental issues registered in this reporting month.

10.0 IMPLEMENTATION STATUS

10.1 Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix I I. Most of the necessary mitigation measures were implemented properly. Any deficiencies were noted in the remarks of the schedule.

10.2 Implementation Status of Event and Action Plan

Since no exceedance of Action and Limit level of air, noise and marine water monitoring results was recorded for this reporting month, no further action was required.

10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

Seven complaints were occurred in this reporting month. The details of the complaints are as below:

- Three complaints received on 20, 21 and 29 May 2016, which were forwarded to ET on 01 June 2016, from EPD (NCF-N08/RE/000012222-16, NCF-N08/RE/000012941-16 and NCF-N08/RE/000012543-16) against the muddy water discharged from TKO137 Fill Bank to the nearby marine area. The complainant complained that muddy water generated caused an environmental nuisance;
- Two complaints received on 25 and 27 May 2016, which were forwarded to ET on 01 June 2016, from EPD (Ref. NCF-N08/RE/000012768-16 and NCF-N08/RE/000013040-16) against the dust emission from barging points at TKO137 Fill Bank. The complainant complained that dust generated caused an environmental nuisance;
- Two complaints received on 22 and 26 May 2016, which were forwarded to ET on 02 June 2016, from 1823 (Case#2-2257302039) & EPD (Ref: NCF-N08/RE/000012545-16) and EPD (Ref. NCF-N08/RE/000013106-16) against the muddy water noted at Wan Po Road near Tseung Kwan O Industrial Estate. The complainant complained that water and waste generated caused an environmental nuisance.

No notification of summon and successful prosecution was received in this month.

A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 10.1 and further details of the complaint could be found in the Complaint Log (Appendix I L).



Table 10.1 Summary of Environmental Complaints and Prosecutions

<i>Complaints logged</i>		<i>Summons served</i>		<i>Successful prosecution received</i>	
<i>May 2016</i>	<i>Cumulative</i>	<i>May 2016</i>	<i>Cumulative</i>	<i>May 2016</i>	<i>Cumulative</i>
7	8	0	0	0	0

11.0 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

Impact monitoring of air quality, noise and water quality were carried out at designated locations in accordance with the EM&A Manual in this reporting month.

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting month.

Since no documented complaints on noise issue were received in this reporting month, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting month.

Seven complaints were occurred in this reporting month. No prosecutions and notifications of summons were received in this reporting month.

According to the ET weekly site inspections carried out in this reporting month, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

Recommendations

According to the environmental site inspections performed in the reporting month, the following recommendations were provided:

Air Quality

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowser;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the site activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

Noise

- Conduct noisy activities at a farther location from the NSRs.

Water Quality

- Maintain the drainage system, including the trapezoidal channels, permanent desilting chambers, regularly;
- Operate and maintain the silt curtains regularly;
- Operate the cleaning vessel within the TKO Basin regularly;
- Clean up the fill material on the concrete pavement at BHA frequently; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.



Landscape and Visual

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeded slopes in accordance with the Landscape Plan.

Chemical and Waste Management

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;
- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain mesh screen on top of the additional drainage to avoid improper dumping of rubbish;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any.

12.0 FUTURE KEY ISSUES

12.1 Work Programme for the Coming Month

As informed by the Contractor, the activities to be conducted by them in the next month included:

1. *Operation of the TKO137 Fill Bank.*
2. *Transferring public fill to vessel and delivering to Taishan and other parties.*
3. *Installation of Height restriction sensor installation*
4. *Modification of Recorder House A2 & weighbridges*
5. *Site Clearance at Portion A1*
6. *Repairing of silt curtain*
7. *Maintenance of tipping hall cladding*

12.2 Key Issues for the Coming Month

Key issues to be considered in the coming month include:

- *Chemical and waste management;*
- *Treatment of runoff and wastewater prior to discharge;*
- *Dust generated from loading and unloading activities; and*
- *Dust generated from dump trucks traffic.*

Mitigation measures to be required in the coming month:

Air Quality Impact

- To provide adequate water spraying on haul roads and working platform;
- To operate and maintain automatic wheel washing facilities properly;
- To dampen the fill material prior to unloading or movement;
- To provide road sweeping on haul road near site egress and public roads outside site egress;
- To ensure implementation of the dust mitigation measures for the site activities;
- To maintain proper operation of the mist spraying system;
- To provide proper maintenance for vehicles and machines on site; and
- To investigate any other dust sources around the air sensitive receivers

Noise

- To switch off equipment if not in use;
- To operate silent equipment;
- To identify the noise sources inside and outside of the site;
- To follow up any exceedance caused by the Fill Bank operation; and
- To re-schedule the work activities in the event of valid noise exceedance.

Water Quality Impact

- To maintain the drainage system in the Fill Bank;
- To ensure the cleanliness of oil interceptor bypass tanks and all the drainage channels;
- To maintain the existing silt trap to ensure good efficiency of wheel wash facilities;



- To repair, inspect and maintain the silt curtains regularly;
- To provide covers for the drip trays to avoid stagnant water pond due to rainfall;
- To provide proper treatment for oily water discharged from the area around air monitoring station TKO-A1;
- To deploy a cleaning vessel to remove floating rubbish in the TKO Basin;
- To clean up the concrete paved area at Portion I every night to avoid fill materials from being washed into the sea; and
- To avoid any stagnant water or provide insecticide to avoid mosquito breeding in the Fill Bank.

Chemical and Waste Management

- To remove waste from the site regularly;
- To properly store and handle chemical wastes on site;
- To implement trip ticket system for all the imported public fill and general refuse disposal;
- To provide and manage sufficiently sized drip trays for diesel drums or chemical containers;
- To remove existing unwanted material in the stockpiles and avoid improper disposal at the Fill Bank through inspection of imported truckloads;
- To maintain proper housekeeping at the workshop area;
- To remove the oil stains in the event of leakage and handle all materials using for this cleaning works as chemical waste;
- To maintain mesh screen on top of the additional drainage, DP3 opening to avoid improper dumping of rubbish into this channel; and
- To identify C&D material by packaging, labeling, storage, transportation and disposal in accordance with statutory regulations.

12.3 Monitoring Schedule for the Coming Month

The proposed EM&A program of the coming month is attached in Appendix I M.


- END OF REPORT -




Appendix I

A

Project Organization Chart

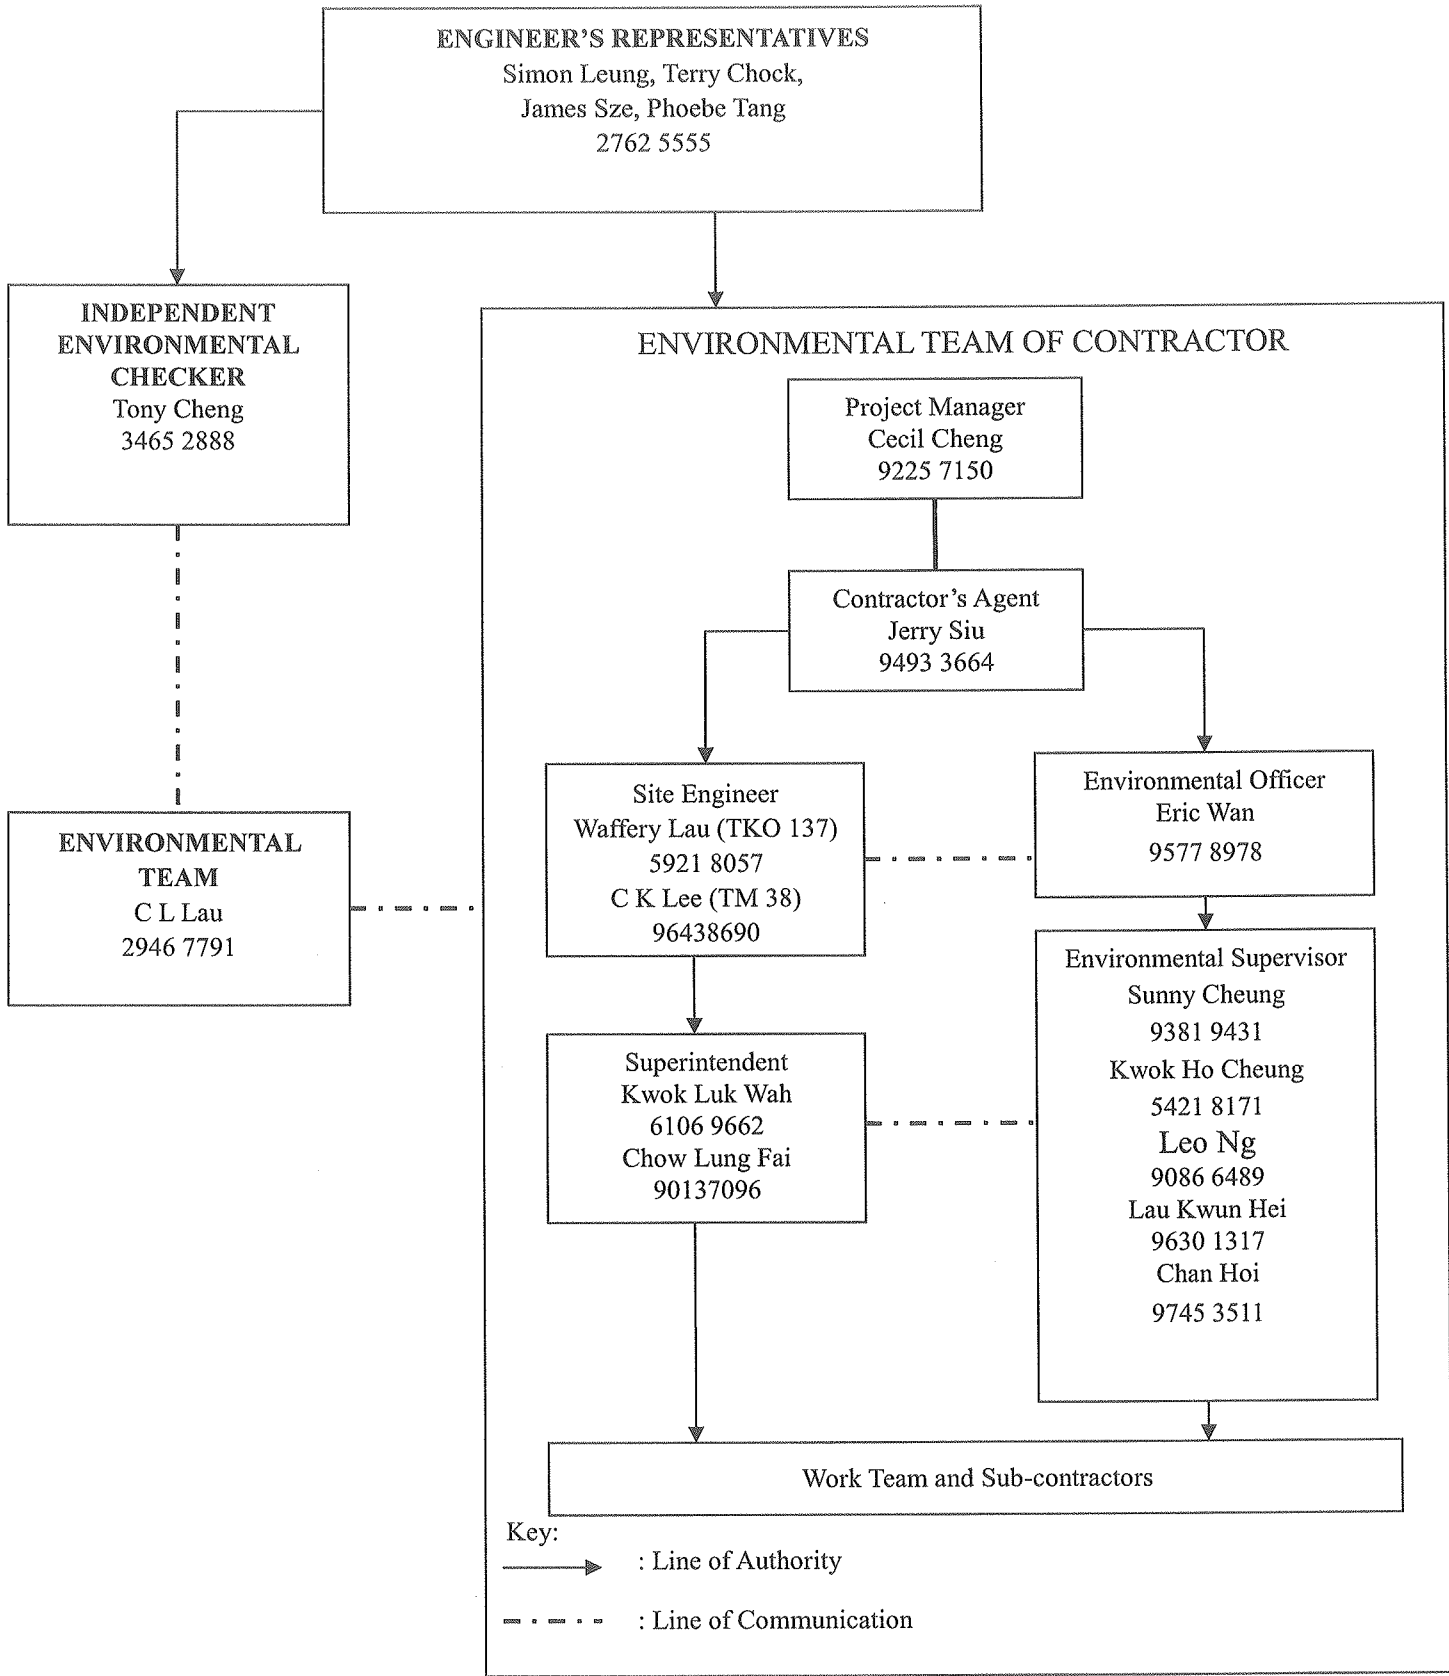




Appendix I

B1

Calibration Certificates for Impact Air Quality Monitoring Equipment

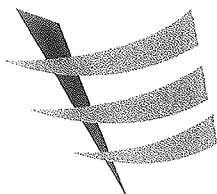

東業德勤測試顧問有限公司

ETS-TESTCONSULT LIMITED

8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong

Tel : 2695 8318

E-mail : etl@ets-testconsult.com

Fax : 2695 3944

Web site : www.ets-testconsult.com

Calibration Report of High Volume Air Sampler


Manufacturer : Graseby GMW Date of Calibration : 06 April 2016

Serial No. : 10581 (ET / EA / 003 / 22) Calibration Due Date : 05 June 2016

Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results	Flow recorder reading (cfm)	55	51	47	35	28
	Qstd (Actual flow rate, m ³ /min)	1.79	1.61	1.43	1.14	0.88
	Pressure : 763.56	Temp. : 293		K		

Sampler 10581 Calibration Curve
Site: Tseung Kwan O 137 (TKO-A1)

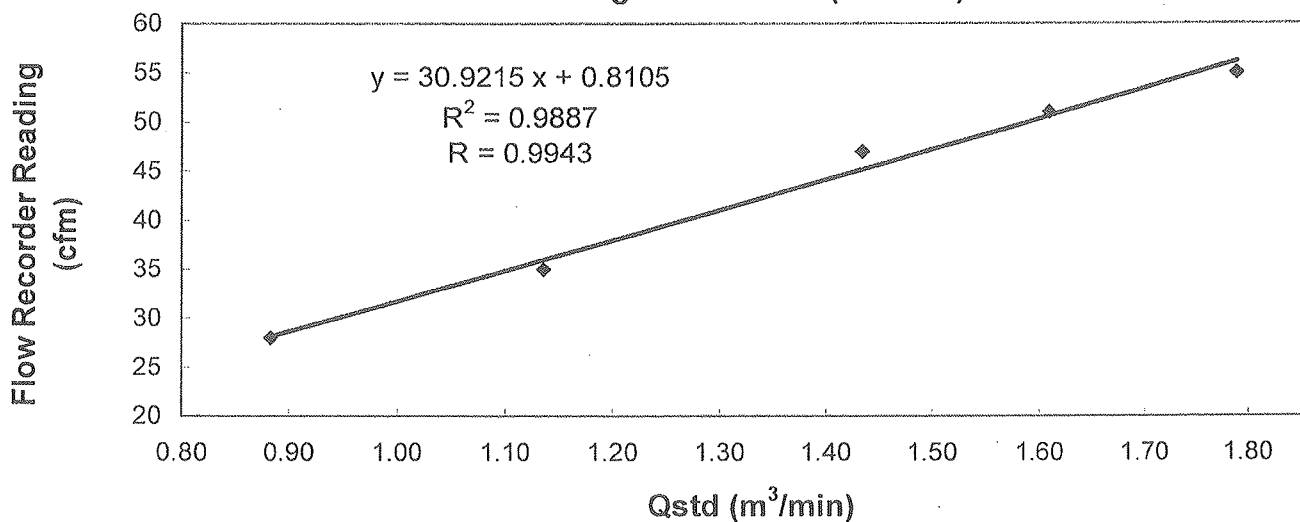


Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies* / does-not-comply* with the specified requirements and is deemed acceptable* / unacceptable* for use.

Calibrated by :
TANG, Chung Hang
(Assistant Supervisor)

Checked by :
LAW, Sau Yee
(Senior Environmental Officer)

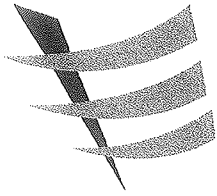

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED


8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

Calibration Report
of
High Volume Air Sampler

Manufacturer : Graseby GMW Date of Calibration : 06 April 2016
Serial No. : 1172 (ET / EA / 003 / 11) Calibration Due Date : 05 June 2016
Method : Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations Manual

Results	Flow recorder reading (cfm)	53	50	41	35	29
	Qstd (Actual flow rate, m ³ /min)	1.80	1.66	1.38	1.15	0.88
	Pressure : 763.56 mm Hg	Temp. : 293 K				

Sampler 1172 Calibration Curve
Site: Tseung Kwan O 137 (TKO-A2a)

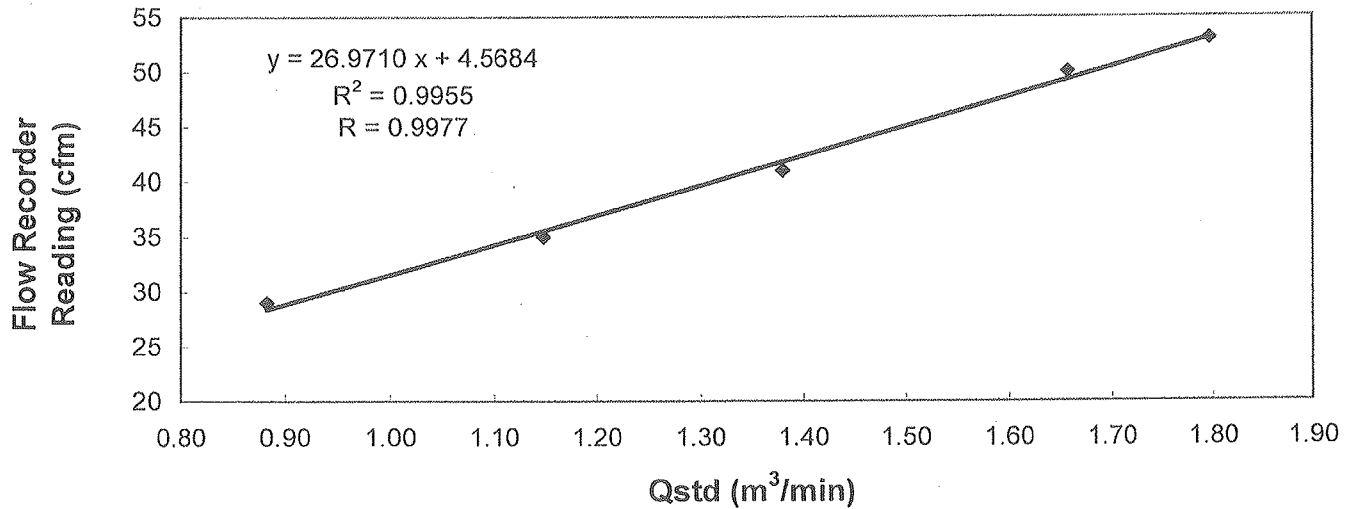

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies* / does not comply* with the specified requirements and is deemed acceptable* / unacceptable* for use.

Calibrated by : 
TANG, Chung Hang
(Assistant Supervisor)

Checked by : 
LAW, Sau Yee
(Senior Environmental Officer)

ET/EA/004/B



TISCH ENVIRONMENTAL, INC.
 145 SOUTH MIAMI AVE
 VILLAGE OF CLEVELAND, OH
 45002
 513.467.9000
 877.263.7610 TOLL FREE
 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Apr 12, 2016 Rootmeter S/N 0438320 Ta (K) - 294
 Operator Tisch Orifice I.D. - 3163 Pa (mm) - 758.19

PLATE OR Run #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER	ORFICE
					DIFF Hg (mm)	DIFF H2O (in.)
1	NA	NA	1.00	1.4390	3.2	2.00
2	NA	NA	1.00	1.0280	6.4	4.00
3	NA	NA	1.00	0.9160	7.9	5.00
4	NA	NA	1.00	0.8760	8.7	5.50
5	NA	NA	1.00	0.7240	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0069	0.6997	1.4221	0.9958	0.6920	0.8806
1.0027	0.9754	2.0112	0.9916	0.9646	1.2454
1.0006	1.0923	2.2485	0.9895	1.0802	1.3924
0.9996	1.1411	2.3583	0.9885	1.1284	1.4604
0.9942	1.3732	2.8442	0.9832	1.3580	1.7613
Qstd slope (m) = 2.11024			Qa slope (m) = 1.32140		
intercept (b) = -0.05237			intercept (b) = -0.03243		
coefficient (r) = 0.99995			coefficient (r) = 0.99995		
y axis = SQRT[H2O(Pa/760) (298/Ta)]			y axis = SQRT[H2O(Ta/Pa)]		

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]
 Qa = Va/Time

For subsequent flow rate calculations:

Qstd = 1/m{ [SQRT(H2O(Pa/760) (298/Ta))] - b}
 Qa = 1/m{ [SQRT H2O(Ta/Pa)] - b}



Appendix I

B2

Impact Air Quality Monitoring Results

Summary of 24-hr TSP Monitoring Results

Monitoring Station : TKO-A1
Location : Site Egress

Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
03/05/16	08:00	04/05/16	08:00	24738.33	24762.33	24.00	1.0087	1.0087	1.0087	2.7892	2.8968	74
09/05/16	09:00	10/05/16	09:00	24766.33	24790.33	24.00	1.0087	1.0087	1.0087	2.7951	2.8998	72
16/05/16	14:10	17/05/16	14:10	24793.33	24817.33	24.00	1.0087	1.0087	1.0087	2.8110	2.9364	86
21/05/16	08:00	22/05/16	08:00	24819.33	24843.33	24.00	1.0087	1.0087	1.0087	2.6952	2.8407	100
27/05/16	11:55	28/05/16	11:55	24847.33	24871.33	24.00	1.0087	1.0087	1.0087	2.8124	2.9450	91

Monitoring Station : TKO-A2a
Location : CREO

Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
		Date	Time	Initial	Final		Initial	Final		Initial	Final	
03/05/16	08:00	04/05/16	08:00	24747.64	24771.64	24.00	1.0171	1.0171	1.0171	2.8035	2.9178	78
09/05/16	09:00	10/05/16	09:00	24775.64	24799.64	24.00	1.0171	1.0171	1.0171	2.8043	2.9178	77
16/05/16	14:15	17/05/16	14:15	24802.64	24826.64	24.00	1.0171	1.0171	1.0171	2.7465	2.8612	78
21/05/16	08:00	22/05/16	08:00	24828.64	24852.64	24.00	1.0171	1.0171	1.0171	2.8043	2.9195	79
27/05/16	11:50	28/05/16	11:50	24856.64	24880.64	24.00	1.0171	1.0171	1.0171	2.7951	2.9086	77

Summary of 1-hr TSP Monitoring Results

Monitoring Station : TKO-A1
Location : Site Egress

Date	Time		Elapsed Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
04/05/16	08:05	09:05	24762.33	24763.33	1.00	1.0087	1.0087	1.0087	2.7936	2.8043	177
04/05/16	09:05	10:05	24763.33	24764.33	1.00	1.0087	1.0087	1.0087	2.7880	2.8004	205
06/05/16	14:00	15:00	24764.33	24765.33	1.00	1.0087	1.0087	1.0087	2.7813	2.7922	180
09/05/16	07:55	08:55	24765.33	24766.33	1.00	1.0087	1.0087	1.0087	2.7891	2.8015	205
11/05/16	11:45	12:45	24790.33	24791.33	1.00	1.0087	1.0087	1.0087	2.7833	2.7950	193
13/05/16	16:10	17:10	24791.33	24792.33	1.00	1.0087	1.0087	1.0087	2.7951	2.8094	236
16/05/16	13:10	14:10	24792.33	24793.33	1.00	1.0087	1.0087	1.0087	2.7843	2.7968	206
18/05/16	16:15	17:15	24817.33	24818.33	1.00	1.0087	1.0087	1.0087	2.7954	2.8078	205
20/05/16	16:45	17:45	24818.33	24819.33	1.00	1.0087	1.0087	1.0087	2.7985	2.8092	177
23/05/16	09:30	10:30	24843.33	24844.33	1.00	1.0087	1.0087	1.0087	2.7951	2.8072	200
23/05/16	10:30	11:30	24844.33	24845.33	1.00	1.0087	1.0087	1.0087	2.8169	2.8304	223
25/05/16	08:20	09:20	24845.33	24846.33	1.00	1.0087	1.0087	1.0087	2.7955	2.8064	180
27/05/16	08:00	09:00	24846.33	24847.33	1.00	1.0087	1.0087	1.0087	2.7899	2.8020	200
30/05/16	09:55	10:55	24871.33	24872.33	1.00	1.0087	1.0087	1.0087	2.7956	2.8077	200

Monitoring Station : TKO-A2a
Location : CREO


Date	Time		Elapsed Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)
	Start	Finish	Initial	Final		Initial	Final		Initial	Final	
04/05/16	08:15	09:15	24771.64	24772.64	1.00	1.0171	1.0171	1.0171	2.8052	2.8173	198
04/05/16	09:15	10:15	24772.64	24773.64	1.00	1.0171	1.0171	1.0171	2.8031	2.8168	224
06/05/16	14:10	15:10	24773.64	24774.64	1.00	1.0171	1.0171	1.0171	2.7796	2.7913	192
09/05/16	08:00	09:00	24774.64	24775.64	1.00	1.0171	1.0171	1.0171	2.8005	2.8142	225
11/05/16	11:50	12:50	24799.64	24800.64	1.00	1.0171	1.0171	1.0171	2.8100	2.8225	205
13/05/16	16:20	17:20	24800.64	24801.64	1.00	1.0171	1.0171	1.0171	2.8043	2.8174	215
16/05/16	13:15	14:15	24801.64	24802.64	1.00	1.0171	1.0171	1.0171	2.8015	2.8119	170
18/05/16	16:20	17:20	24826.64	24827.64	1.00	1.0171	1.0171	1.0171	2.8037	2.8194	175
20/05/16	16:50	17:50	24827.64	24828.64	1.00	1.0171	1.0171	1.0171	2.8137	2.8250	185
23/05/16	09:37	10:37	24852.64	24853.64	1.00	1.0171	1.0171	1.0171	2.8033	2.8146	185
23/05/16	10:37	11:37	24853.64	24854.64	1.00	1.0171	1.0171	1.0171	2.7942	2.8051	179
25/05/16	08:30	09:30	24854.64	24855.64	1.00	1.0171	1.0171	1.0171	2.8032	2.8156	203
27/05/16	08:00	09:00	24855.64	24856.64	1.00	1.0171	1.0171	1.0171	2.8134	2.8273	228
30/05/16	10:00	11:00	24880.64	24881.64	1.00	1.0171	1.0171	1.0171	2.8001	2.8136	221

Appendix I


B3


Graphical Plots of Impact Air Quality Monitoring Data

24-hour TSP level at TKO-A1

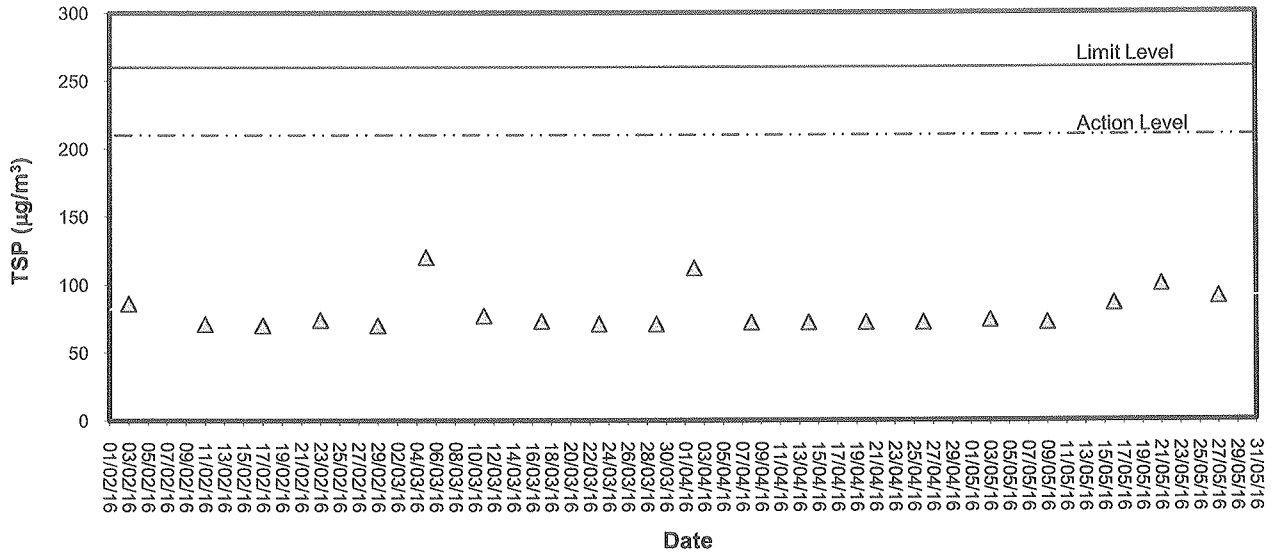


24-hour TSP level at TKO-A2a

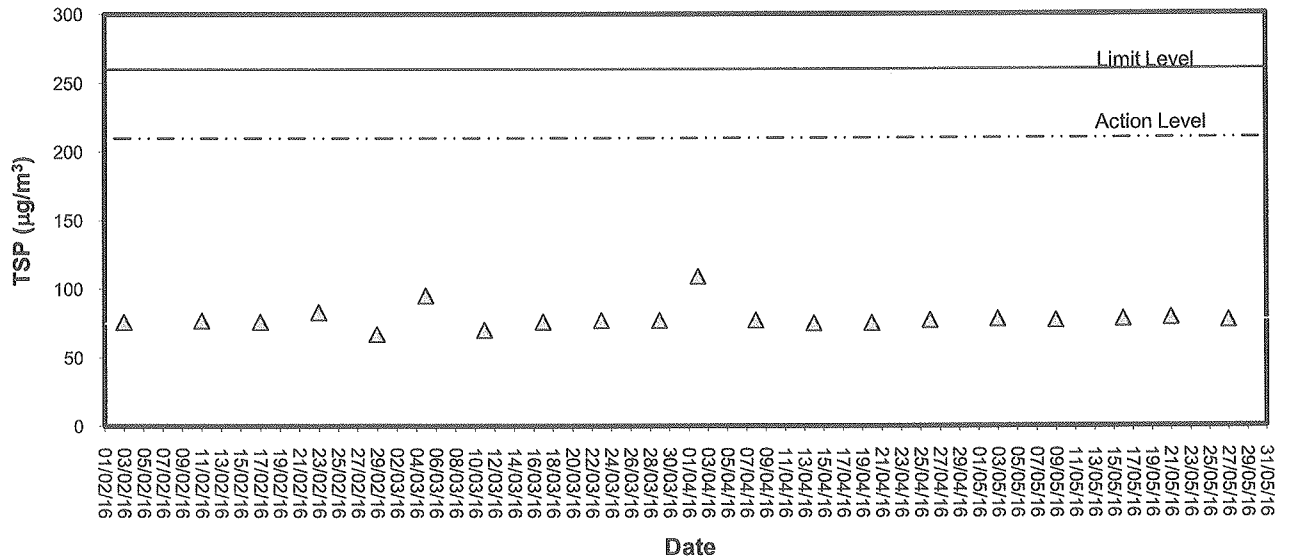




1-hour TSP level at TKO-A1

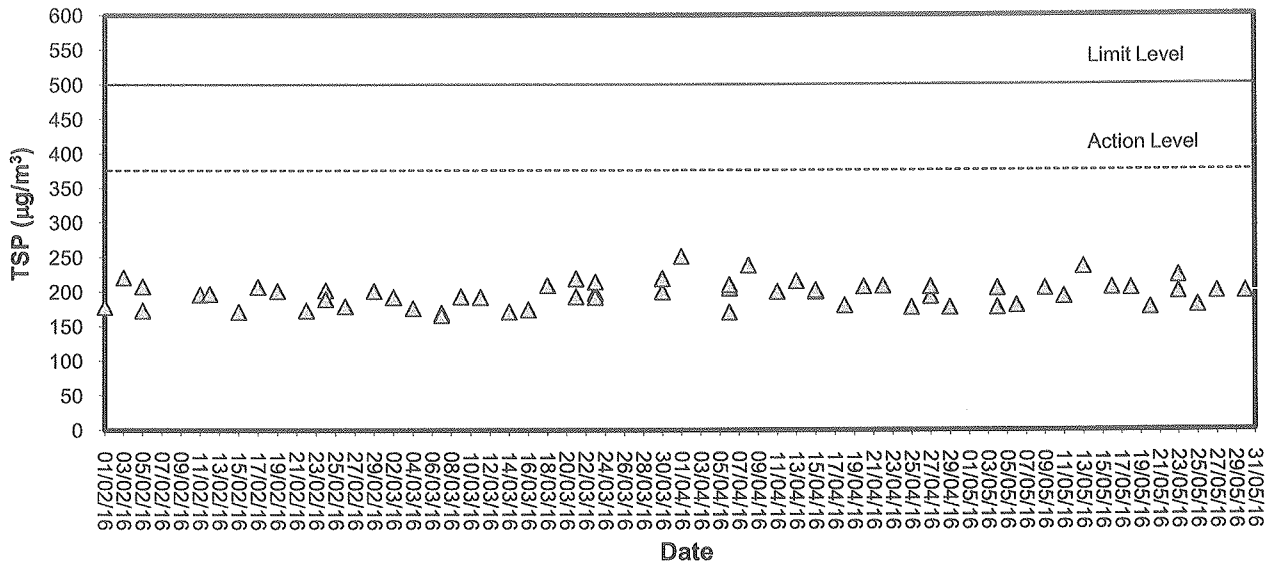

1-hour TSP level at TKO-A2a

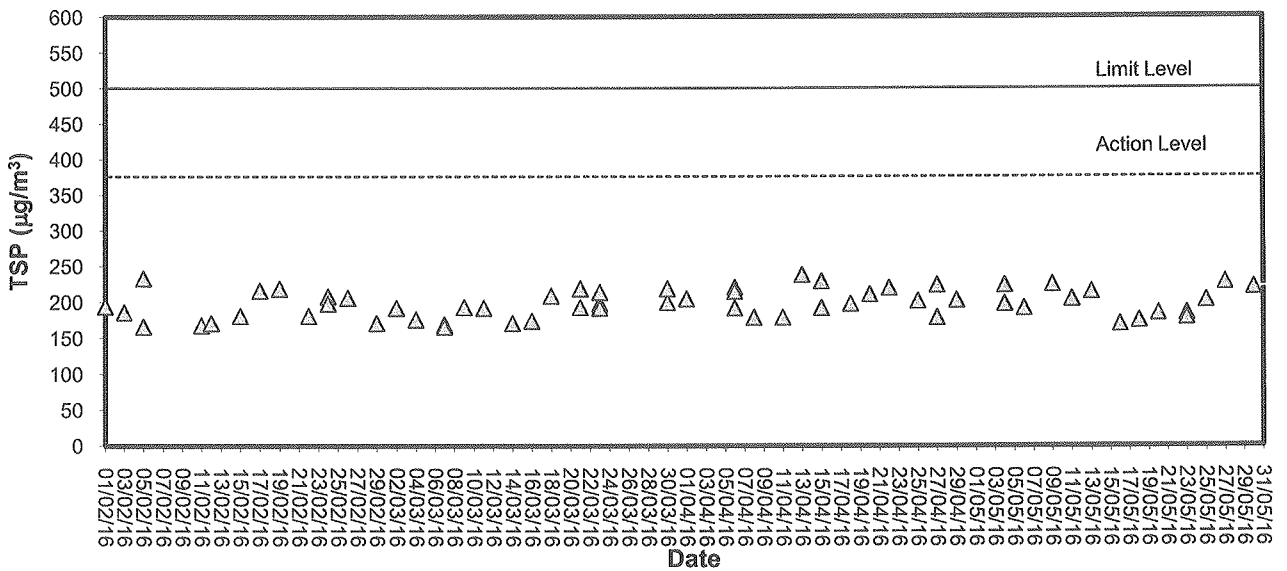




Appendix I

C1

Calibration Certificates for Impact Noise Monitoring Equipment



Calibration Certificate

Certificate No. 508914

Page 1 of 2 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q53461

Date of receipt : 13-Oct-15

Item Tested

Description : Sound Level Calibrator (ET/EN/002/01)

Manufacturer : Rion

Model : NC-73

Serial No. : 10196943

Test Conditions

Date of Test : 29-Oct-15

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : F21, Z02.

Test Results

All results were within the manufacturer's specification.

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S014	Spectrum Analyzer	505317	NIM-PRC & SCL-HKSAR
S240	Sound Level Calibrator	500563	NIM-PRC & SCL-HKSAR
S041	Universal Counter	506951	SCL-HKSAR
S206	Sound Level Meter	506958	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).


The test results apply to the above Unit-Under-Test only

Calibrated by : 
Alan Chu

Approved by : 
Steve Kwan

This Certificate is issued by:
Hong Kong Calibration Ltd.
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.
Tel: 2425 8801 Fax: 2425 8646

Date: 29-Oct-15



Calibration Certificate

Certificate No. 508914

Page 2 of 2 Pages

Results :

1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94 dB	94.1 dB	± 1 dB

Uncertainty : ± 0.2 dB

2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	1.014 kHz	± 2 %

Uncertainty : ± 0.1 %

3. Level Stability : 0.0 dB

Uncertainty : ± 0.01 dB

4. Total Harmonic Distortion : < 1.0 %

Mfr's Spec. : < 3 %

Uncertainty : ± 2.3 % of reading

Remarks: 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure : 1013 hPa

----- END -----



Calibration Certificate

Certificate No. 505086

Page 1 of 4 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q51999

Date of receipt : 15-Jun-15

Item Tested

Description : Sound Level Meter (ET/EN/003/15)

Manufacturer : Rion

Model : NL-52

Serial No. : FADED

Test Conditions

Date of Test : 30-Jun-15

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure: Z01, IEC 61672.

Test Results

All results were within the IEC 61672 Type1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No.	Description	Cert. No.	Traceable to
S017	Multi-Function Generator	C147450	SCL-HKSAR
S240	Sound Level Calibrator	500563	NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).

The test results apply to the above Unit-Under-Test only

Calibrated by : 
Dorothy Cheuk

Approved by : 
Steve Kwan

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646

Date: 30-Jun-15



Calibration Certificate

Certificate No. 505086

Page 2 of 4 Pages

Results :

1. Self-generated noise: 13.5 dBA (Mfr's Spec \leq 17 dBA)

2. Acoustical signal test

UUT Setting				Applied Value (dB)	UUT Reading (dB)
Range (dB)	Frequency Weighting	Time Weighting	Octave Filter		
30-130	A	F	OFF	94.0	93.7
		S	OFF		93.7
	C	F	OFF		93.7
	Z	F	OFF		93.7
	A	F	OFF	114.0	113.7
			OFF		113.7
		C	OFF		113.7
		Z	OFF		113.7

IEC 61672 Type 1 Spec. : \pm 1.1 dB

Uncertainty : \pm 0.1 dB

3 Electrical signal tests of frequency weightings (A weighting)

Frequency	Attenuation (dB)	IEC 61672 Type 1 Spec.
31.5 Hz	-39.7	- 39.4 dB, \pm 2 dB
63 Hz	-26.2	- 26.2 dB, \pm 1.5 dB
125 Hz	-16.1	- 16.1 dB, \pm 1.5 dB
250 Hz	-8.6	- 8.6 dB, \pm 1 dB
500 Hz	-3.2	- 3.2 dB, \pm 1.4 dB
1 kHz	0.0 (Ref)	0 dB, \pm 1.1 dB
2 kHz	+1.1	+ 1.2 dB, \pm 1.6 dB
4 kHz	+0.7	+ 1.0 dB, \pm 1.6 dB
8 kHz	-1.1	- 1.1 dB, + 2.1 dB ~ -3.1 dB
16 kHz	-8.5	- 6.6 dB, + 3.5 dB ~ - 17.0 dB

Uncertainty : \pm 0.1 dB



Calibration Certificate

Certificate No. 505086

Page 3 of 4 Pages

4. Frequency & Time weightings at 1 kHz

4.1 Frequency Weighting (Fast)

UUT Setting	Applied Value (dB)	UUT Reading (dB)	Difference (dB)	IEC 61672 Type 1 Spec.
A	94.0	93.7 (Ref.)	--	± 0.4 dB
C	94.0	93.7	0.0	
Z	94.0	93.7	0.0	

4.2 Time Weighting (A-weighted)

UUT Setting	Applied Value (dB)	UUT Reading (dB)	Difference (dB)	IEC 61672 Type 1 Spec.
Fast	94.0	93.7 (Ref.)	--	± 0.3 dB
Slow	94.0	93.7	0.0	
Time-averaging	94.0	93.7	0.0	

Uncertainty : ± 0.1 dB

5. Level linearity on the reference level range

UUT Range	Applied Value (dB)	UUT Reading (dB)	Difference (dB)	IEC 61672 Type 1 Spec.
30-130 dB (Ref Level)	129.0	129.0	0.0	± 1.1 dB
	124.0	124.0	0.0	
	119.0	119.0	0.0	
	114.0	113.7 (Ref)	--	
	109.0	109.0	0.0	
	104.0	104.0	0.0	
	99.0	99.0	0.0	
	94.0	94.0	0.0	
	89.0	89.0	0.0	
	84.0	84.0	0.0	
	79.0	79.0	0.0	
	74.0	74.0	0.0	
	69.0	69.0	0.0	
	64.0	64.0	0.0	
	59.0	59.0	0.0	
	54.0	54.0	0.0	
	49.0	49.0	0.0	
44.0	44.0	0.0		

Uncertainty : ± 0.1 dB



Calibration Certificate

Certificate No. 505086

Page 4 of 4 Pages

6. Toneburst response (4kHz)

UUT Setting	Tone Burst Duration(ms)	UUT Reading(dB)	Difference (dB)	IEC 61672 Type 1 Spec.
Fast	Steady	127.0(Ref)	--	--
	200	126.0	0.0	-1.0 ± 0.8dB
	2	108.9	-18.1	-18.0, +1.3 dB ~ -1.8 dB
	0.25	99.9	-27.1	-27.0, +1.3 dB ~ -3.3 dB
Slow	Steady	127.0(Ref)	--	--
	200	119.5	-7.5	-7.4 ± 0.8dB
	2	99.9	-27.1	-27.0, +1.3 dB ~ -3.3 dB
Time averaging	Steady	127.0(Ref)	--	--
	200	120.4	-6.6	-7.0±0.8dB
	2	100.2	-26.8	-27.0, +1.3 dB ~ -1.8 dB
	0.25	92.7	-34.3	-36.0, +1.3 dB ~ -3.3 dB

Uncertainty : ± 0.1 dB

7. Overload indication (30-130 dB range, A-weighted, Time-average, 4kHz)

UUT Reading at overload (dB)		Difference (dB)	IEC 61672 Type 1 Spec.
+ ve one half cycle	- ve one half cycle		
136.8	136.8	0.0	< 1.8 dB

The overload indicator latched on until reset

Uncertainty : ± 0.1 dB

Remarks : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure : 1012 hPa.

4. Preamplifier model : NH-25 , S/N : 20852

5. Firmware Version: 1.2

6. Power Supply Check: OK

7. The UUT was adjusted with the laboratory's sound calibrator at the reference sound pressure level before the calibration.

----- END -----



Appendix I


C2

Impact Noise Monitoring Results

Day-time Noise Monitoring

Monitoring Location: TKO-N1 (Site Egress)


Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq} (30min)	L ₁₀	L ₉₀		
18/05/16	14:15	70.5	74.2	69.3	0.2	Fine



Appendix I


C3


Graphical Plots of Impact Noise Monitoring Data



Noise Monitoring (Day-time)

Noise level at TKO-N1

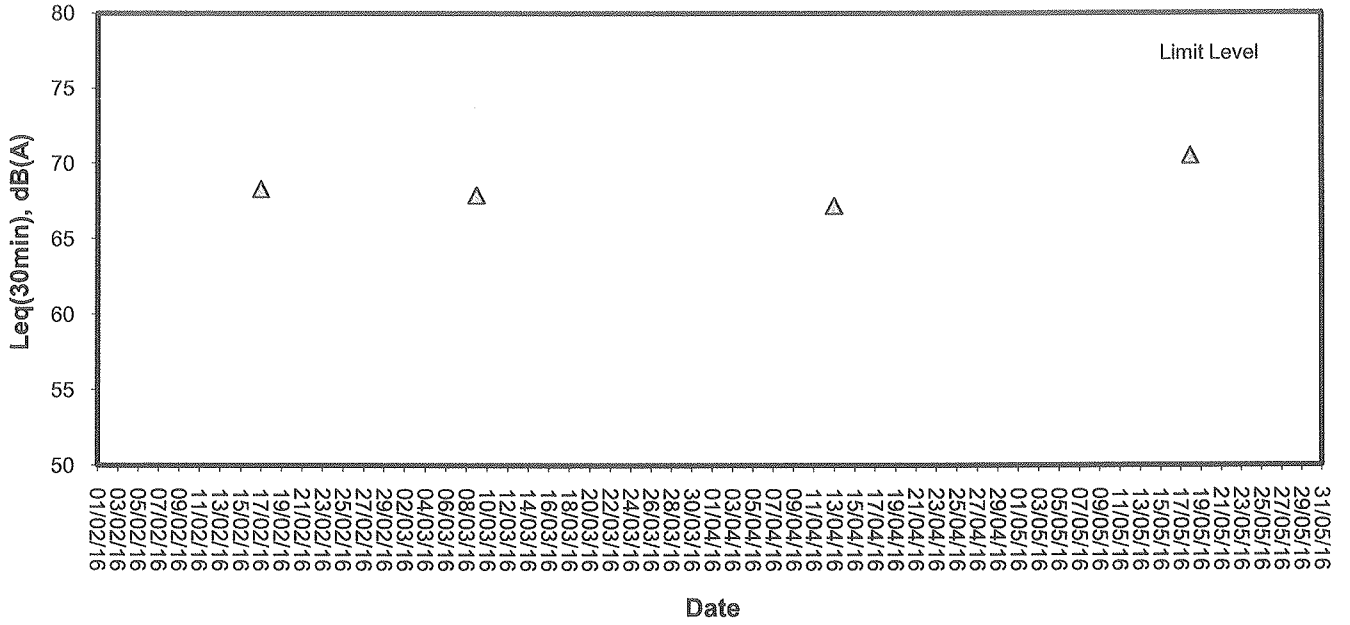



Appendix I

D1

Calibration Certificates for Impact Marine Water Quality Monitoring Equipments



Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/005</u>	Manufacturer : <u>YSI</u>
Model No. : <u>Pro 2030</u>	Serial No. : <u>12A 100353</u>
Date of Calibration : <u>26/04/2016</u>	Calibration Due Date : <u>25/07/2016</u>

Temperature Verification

Ref. No. of Reference Thermometer : ET/0521/017

Ref. No. of Water Bath : ---

		Temperature (°C)		
Reference Thermometer reading	Measured	20.0	Corrected	20.1
DO Meter reading	Measured	19.9	Difference	0.2

Standardization of sodium thiosulphate (Na₂S₂O₃) solution

Reagent No. of Na ₂ S ₂ O ₃ titrant	CPE/012/4.5/001/13	Reagent No. of 0.025N K ₂ Cr ₂ O ₇	CPE/012/4.4/002/09
		Trial 1	Trial 2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)		0.00	10.20
Final Vol. of Na ₂ S ₂ O ₃ (ml)		10.20	20.40
Vol. of Na ₂ S ₂ O ₃ used (ml)		10.20	10.20
Normality of Na ₂ S ₂ O ₃ solution (N)		0.02451	0.02451
Average Normality (N) of Na ₂ S ₂ O ₃ solution (N)		0.02451	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na₂S₂O₃, N = 0.25 / ml Na₂S₂O₃ used

Linearity Checking

Determination of dissolved oxygen content by Winkler Titration *

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	10.90	21.90	0.00	6.80	10.50
Final Vol. of Na ₂ S ₂ O ₃ (ml)	10.90	21.90	28.50	6.80	10.50	14.10
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	10.90	11.00	6.60	6.80	3.70	3.60
Dissolved Oxygen (DO), mg/L	7.17	7.24	4.34	4.47	2.43	2.37
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.34	7.43	7.39	7.17	7.24	7.21	2.47
5	4.21	4.33	4.27	4.34	4.47	4.41	3.23
10	2.46	2.55	2.51	2.43	2.37	2.40	4.48
Linear regression coefficient				0.9958			



Internal Calibration Report of Dissolved Oxygen Meter

Zero Point Checking

DO meter reading, mg/L	0.00
------------------------	------

Salinity Checking

Reagent No. of NaCl (10ppt)	CPE/012/4.7/003/21	Reagent No. of NaCl (30ppt)	CPE/012/4.8/003/21
-----------------------------	--------------------	-----------------------------	--------------------

Determination of dissolved oxygen content by Winkler Titration **

Salinity (ppt)	10		30	
	1	2	1	2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	11.30	22.70	32.30
Final Vol. of Na ₂ S ₂ O ₃ (ml)	11.30	22.70	32.30	41.90
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	11.30	11.40	9.60	9.60
Dissolved Oxygen (DO), mg/L	7.44	7.50	6.32	6.32
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: $DO (mg/L) = V \times N \times 8000/298$

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.25	7.22	7.24	7.44	7.50	7.47	3.13
30	6.47	6.52	6.5	6.32	6.32	6.32	2.81

Acceptance Criteria

- (1) Differenc between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / ~~does not comply~~ # with the specified requirements and is deemed acceptable # / ~~unacceptable~~ # for use.

Delete as appropriate

Calibrated by :

Approved by :



Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/005 Manufacturer : YSI
Model No. : Pro 2030 Serial No. : 12A 100353
Date of Calibration : 26/04/2016 Due Date : 25/07/2016

Ref. No. of Salinity Standard used (30ppt)

S/001/5

Salinity Standard (ppt)	Measured Salinity (ppt)	Difference * (%)
30.0	30.3	1.00

(*) Difference (%) = (Measured Salinity – Salinity Standard value) / Salinity Standard value x 100

Acceptance Criteria

Difference : -10 % to 10 %

The salinity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Checked by : hy

Approved by : [Signature]



Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/011 Manufacturer : HACH

Model No. : 2100Q Serial No. : 2060C013574
41110 C 014260

Date of Calibration : 31/03/2015 ²⁰¹⁶ Due Date : 30/06/2016

Ref. No. of Turbidity Standard used (4000NTU)

005/6.1/001/9


Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	19.8	-1.00
100	104	4.00
800	780	-2.50

(*) Difference = (Measured Value – Theoretical Value) / Theoretical Value x 100


Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 



Appendix I

D2

Impact Marine Water Quality Monitoring Results

Mid-Flood Tide



東業德動測試顧問有限公司
ETS-TEST CONSULT LIMITED

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average
04/05/16	1537-1551	28/Cloudy	Surface	24.1	28.7	28.6	7.68	7.71	7.76	104.8	105.2	1.78	1.81	2.7	2.8	3.5	
			Middle	24.0	28.3	28.3	7.73	7.81	7.76	105.5	106.5	1.84	2.46	2.8	3.8		
			Bottom	24.0	28.2	28.6	7.82	7.79	7.87	106.7	107.5	2.43	2.91	3.6	4.0		
06/05/16	1706-1720	29/Cloudy	Surface	23.7	28.6	28.3	7.84	7.87	7.87	107.1	107.5	2.88	2.91	3.5	4.0	3.0	
			Middle	23.6	28.9	28.8	7.89	7.05	7.01	107.8	97.1	4.4	2.40	4.4	3.4		
			Bottom	23.6	29.0	28.9	7.89	7.25	7.21	107.7	99.4	2.93	2.29	3.0	2.9		
09/05/16	0813-0825	29/Cloudy	Surface	23.8	29.1	29.2	7.06	7.09	7.13	99.7	99.1	2.96	3.01	4.7	4.2	5.0	
			Middle	23.4	29.5	29.4	7.11	7.17	7.13	99.4	100.0	3.05	3.18	3.7	4.8		
			Bottom	23.3	29.3	29.6	7.20	7.40	7.40	100.4	102.8	3.20	4.12	4.5	6.0		
11/05/16	0800-0818	29/Cloudy	Surface	24.0	29.5	29.4	7.37	7.08	7.12	102.4	99.5	4.15	3.12	5.1	4.7	4.7	
			Middle	23.7	29.4	29.5	7.42	7.16	7.12	103.1	100.2	4.08	2.95	4.3	4.0		
			Bottom	23.5	29.7	29.8	7.10	7.31	7.31	99.3	102.0	2.91	3.84	4.4	5.4		
13/05/16	0930-0946	25/Cloudy	Surface	23.7	29.0	29.1	7.29	7.15	7.17	101.8	99.6	3.87	3.39	5.0	4.9	5.1	
			Middle	23.5	29.3	29.3	7.13	7.19	7.17	99.4	100.3	3.42	3.17	4.8	4.2		
			Bottom	23.3	29.2	29.5	7.20	7.19	7.19	100.5	98.4	3.20	4.07	4.1	6.1		
16/05/16	1400-1418	26/Fine	Surface	26.1	28.4	28.5	7.07	7.06	7.06	98.9	106.7	4.03	3.35	5.8	5.4	5.0	
			Middle	25.9	28.2	28.2	7.04	7.40	7.35	97.8	106.8	4.11	3.34	5.4	5.4		
			Bottom	25.7	28.3	28.4	7.36	7.23	7.23	96.5	97.5	3.50	3.42	5.3	4.6		
18/05/16	1535-1550	26/Cloudy	Surface	24.9	28.9	29.0	7.24	7.34	7.27	96.3	104.6	2.63	2.67	4.9	4.9	4.4	
			Middle	24.8	29.2	29.2	7.32	7.21	7.21	104.8	102.6	2.71	3.30	3.2	3.8		
			Bottom	24.8	29.3	29.3	7.18	7.17	7.17	102.9	102.0	3.34	3.77	4.3	4.8		
20/05/16	1708-1722	24/Cloudy	Surface	24.8	29.2	29.3	7.23	7.42	7.33	102.3	106.0	3.74	2.32	4.5	3.4	4.4	
			Middle	24.8	29.6	29.5	7.19	7.25	7.25	101.6	103.4	3.80	3.22	5.0	4.7		
			Bottom	24.7	29.5	29.4	7.14	7.22	7.22	102.3	103.0	2.27	3.69	4.7	5.2		

Remark (*): Flood tide of WQM at 27 May 2016 was cancelled due to bad weather (Typhoon Signal No.3).

Mid-Flood Tide



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average
23/05/16	1830-1847	30/Cloudy	Surface	25.1	28.5	28.5	7.86	7.84	111.7	111.4	2.87	2.91	3.4	3.7	3.8		
					28.5	7.81	111.0	2.95	4.0								
			Middle	25.0	28.7	28.7	7.72	7.70	109.8	109.5	2.66	2.69	3.2	3.5			
					28.6	7.68	109.2	2.71	3.8								
			Bottom	24.9	28.9	28.9	7.43	7.41	105.8	105.5	3.09	3.12	4.3	4.1			
					28.9	7.38	105.1	3.15	3.8								
25/05/16	0813-0827	28/Cloudy	Surface	26.0	28.9	29.0	6.84	6.86	98.9	99.2	2.39	2.44	3.1	3.2	4.3		
					29.0	6.88	99.5	2.48	3.2								
			Middle	25.9	29.2	29.3	6.98	7.01	100.8	101.3	2.98	3.02	3.6	4.0			
					29.3	7.04	101.8	3.06	4.3								
			Bottom	25.9	29.3	29.2	7.16	7.21	103.5	104.0	3.81	3.77	6.1	5.7			
					29.1	7.25	104.4	3.73	5.2								
27/05/16	*	*	Surface	*	*	*	*	*	*	*	*	*	*	*			
					Middle	*	*	*	*	*	*	*	*	*	*		
					Bottom	*	*	*	*	*	*	*	*	*	*		
					Surface	28.0	28.1	7.21	7.24	105.7	106.1	2.83	2.79	4.0	3.8		
					Middle	28.2	28.8	7.26	7.16	106.4	104.7	2.75	3.48	3.6	4.9		
					Bottom	28.9	28.9	7.18	7.09	104.9	103.7	3.45	3.82	5.2	4.8		
30/05/16	1138-1153	30/Cloudy	19.4	26.6	28.8	28.8	7.14	7.09	104.4	103.3	3.51	3.77	4.6	4.8			
					28.8	7.06	103.3	3.77	5.0								
					28.9	7.11	104.0	3.86	4.6								

Mid-Flood Tide

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Value	Depth-average	Value	Average
04/05/16	1650-1705	28/Cloudy	Surface	23.9	28.8	28.7	7.27	7.29	7.22	99.7	100.0	2.47	2.51	4.0	3.7	3.9	
					28.6	7.31	100.2	2.55	3.3	2.76							
					28.9	7.18	98.5	2.71	3.8								
06/05/16	1818-1833	29/Cloudy	Middle	23.8	29.0	29.0	7.11	7.15	7.11	97.4	98.0	2.66	2.69	3.5	3.7	3.3	
					29.1	7.08	97.1	3.13	3.9								
					29.2	7.04	96.5	3.03	4.5								
09/05/16	0928-0941	29/Cloudy	Bottom	23.7	28.7	28.8	7.38	7.42	7.32	101.8	102.4	2.43	2.39	3.4	3.3	3.3	
					28.9	7.46	102.9	2.35	3.1								
					29.1	7.19	99.2	2.76	3.6								
11/05/16	0940-1000	29/Cloudy	Middle	23.3	29.0	29.1	7.26	7.23	7.23	100.1	99.7	2.79	2.78	4.0	4.2	4.8	
					29.2	7.10	97.9	2.22	3.3								
					29.2	7.14	98.4	2.30	4.3								
13/05/16	1103-1120	25/Cloudy	Surface	23.3	29.2	29.1	7.33	7.35	7.35	101.9	102.2	3.93	3.98	6.3	5.8	4.7	
					29.2	7.37	102.5	4.02	5.2								
					29.3	7.15	100.6	3.25	3.9								
16/05/16	1540-1600	26/Cloudy	Middle	23.8	29.2	29.3	7.20	7.18	7.21	101.3	101.0	3.18	3.22	4.5	4.2	4.4	
					29.3	7.24	101.7	3.06	4.3								
					29.4	7.26	102.1	3.11	4.7								
18/05/16	1652-1707	26/Cloudy	Bottom	24.0	29.4	29.5	7.36	7.35	7.35	103.1	103.0	3.75	3.73	5.6	5.4	4.8	
					29.5	7.33	102.8	3.71	5.2								
					29.1	7.27	101.4	3.27	4.3								
20/05/16	1824-1839	24/Cloudy	Surface	23.5	29.1	29.1	7.24	7.26	7.27	101.0	101.2	3.20	3.24	4.3	4.1	4.0	
					29.1	7.30	101.9	3.11	3.8								
					29.1	7.28	101.7	3.18	3.8								
18/05/16	1540-1600	26/Cloudy	Middle	23.7	29.3	29.3	7.17	7.15	7.15	100.1	99.9	3.79	3.81	4.9	5.3	4.8	
					29.3	7.13	99.6	3.82	5.7								
					29.3	7.13	100.1	3.15	4.4								
18/05/16	1652-1707	26/Cloudy	Bottom	24.7	28.0	28.1	7.45	7.46	7.38	107.5	107.6	3.15	3.14	4.4	4.6	4.2	
					28.1	7.47	107.7	3.13	4.7								
					28.2	7.31	97.8	3.24	4.9								
20/05/16	1824-1839	24/Cloudy	Surface	24.6	28.3	28.3	7.29	7.30	7.35	97.6	97.7	3.26	3.25	4.6	4.8	4.0	
					28.3	7.13	95.1	3.30	5.3								
					28.4	7.15	95.3	3.32	4.6								
18/05/16	1652-1707	26/Cloudy	Middle	24.7	29.5	29.5	7.03	7.06	7.17	100.1	100.5	2.47	2.50	3.2	3.5	4.2	
					29.4	7.09	100.9	2.52	3.8								
					29.3	7.23	102.9	3.08	4.0								
20/05/16	1824-1839	24/Cloudy	Bottom	24.6	29.5	29.4	7.31	7.27	7.35	104.1	103.5	3.14	3.11	3.8	3.9	4.0	
					29.5	7.07	100.6	3.35	5.1								
					29.2	7.14	101.6	3.42	5.1								
20/05/16	1824-1839	24/Cloudy	Surface	24.6	29.5	29.6	7.28	7.31	7.35	103.9	104.3	2.34	2.38	3.0	3.3	4.0	
					29.7	7.33	104.6	2.42	3.6								
					29.8	7.37	105.3	2.69	3.5								
20/05/16	1824-1839	24/Cloudy	Middle	24.6	29.6	29.7	7.42	7.40	2.72	105.8	105.6	2.75	2.72	4.4	4.0	4.0	
					29.6	7.25	103.5	3.38	4.7								
					29.3	7.29	104.1	3.44	4.5								

Mid-Flood Tide

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average
23/05/16	2004-2041	30/Cloudy	Surface	1.0	25.1	28.5	28.6	7.95	7.93	11.3	61.9	2.74	2.79	3.8	3.6	3.7			
						28.6	7.91	112.4	2.83	3.4									
						28.7	7.84	112.9	2.54	3.6									
25/05/16	0928-0943	28/Cloudy	Middle	5.4	25.1	28.7	28.7	7.81	7.83	111.1	112.0	2.61	2.58	3.7	3.8				
						28.8	7.63	108.6	2.89	3.5									
						28.7	7.60	108.2	2.96	4.1									
27/05/16	*	*	Surface	1.0	26.1	29.4	29.3	7.06	7.04	102.3	102.0	2.17	2.21	2.8	3.2	3.7			
						29.2	7.01	101.6	2.25	3.6									
						29.1	7.16	103.7	2.88	3.7									
30/05/16	1255-1310	30/Cloudy	Middle	5.3	26.0	29.0	29.1	7.22	7.19	104.6	104.2	2.94	2.91	4.1	3.9	4.4			
						29.2	7.37	106.8	3.07	4.3									
						29.3	7.32	106.1	3.16	3.8									
27/05/16	*	*	Bottom	9.5	25.9	29.3	29.3	7.35	7.35	106.5	106.5	3.12	3.12	4.1	4.1	3.7			
						*	*	*	*	*	*	*	*	*					
						*	*	*	*	*	*	*	*	*					
27/05/16	*	*	Middle	*	*	*	*	*	*	*	*	*	*	*	3.7				
						*	*	*	*	*	*	*	*	*					
						*	*	*	*	*	*	*	*	*					
30/05/16	1255-1310	30/Cloudy	Bottom	9.5	26.5	28.9	28.8	7.04	7.08	102.9	103.5	3.15	3.12	4.1	4.2	4.4			
						28.7	7.12	104.1	3.08	4.3									
						28.5	28.6	7.19	7.17	104.9	104.6	2.95	2.99	4.8	4.8				
30/05/16	1255-1310	30/Cloudy	Surface	1.0	26.7	28.5	28.6	7.19	7.17	104.9	104.6	2.95	2.99	4.8	4.8	4.4			
						28.7	7.14	104.2	3.03	4.8									
						28.8	28.9	6.98	6.96	101.9	101.6	3.27	3.26	4.3	4.2				
30/05/16	1255-1310	30/Cloudy	Middle	5.3	26.6	28.8	28.9	6.93	6.96	101.2	101.6	3.24	3.26	4.0	4.2	4.4			
						28.9	7.04	102.9	3.15	4.1									
						28.7	7.12	104.1	3.08	4.3									

Mid-Ebb Tide

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
04/05/16	0935-0949	25/Cloudy	Surface	1.0	22.7	28.9	29.0	7.82	7.85	7.79	107.2	107.6	1.87	1.91	2.8	3.0	3.5	
			Middle	8.8	22.6	29.1	29.1	7.87	7.73	107.9	105.9	1.95	2.30	3.1	3.2			
			Bottom	16.5	22.5	29.2	29.3	7.70	7.85	105.5	106.3	2.25	2.80	3.4	4.3			
06/05/16	1107-1121	28/Cloudy	Surface	1.0	23.1	29.2	29.3	7.76	7.85	7.85	107.9	107.4	2.83	2.80	4.5	4.3	3.0	
			Middle	8.8	23.1	29.1	29.1	7.81	7.06	106.9	97.3	2.76	2.21	4.1	3.2			
			Bottom	16.6	23.0	29.3	29.2	6.78	7.27	93.5	100.2	1.86	2.36	3.0	3.0			
09/05/16	1300-1512	30/Cloudy	Surface	1.0	23.9	29.2	29.3	6.83	7.02	7.06	98.4	98.2	3.28	3.21	4.6	4.2	4.7	
			Middle	10.2	23.6	29.4	29.4	7.07	7.10	97.9	99.3	3.14	3.04	3.8	4.3			
			Bottom	19.3	23.4	29.3	29.7	7.04	7.25	99.0	101.5	3.07	3.93	4.0	5.7			
11/05/16	1500-1518	29/Cloudy	Surface	1.0	24.1	29.5	29.6	7.12	7.07	7.03	98.5	98.3	3.96	3.18	4.5	4.8	4.7	
			Middle	10.2	23.8	29.5	29.6	7.08	7.07	98.1	99.0	3.11	3.01	4.7	4.1			
			Bottom	19.4	23.6	29.6	29.9	7.1	7.22	98.7	100.6	2.97	3.90	4.5	5.3			
13/05/16	1600-1616	27/Cloudy	Surface	1.0	23.7	29.1	29.1	7.08	7.10	7.07	98.7	98.9	3.59	3.52	5.4	5.1	4.9	
			Middle	10.1	23.6	29.3	29.3	7.11	7.04	99.1	98.3	3.44	3.34	4.8	4.2			
			Bottom	19.2	23.4	29.5	29.5	7.05	6.88	98.4	100.8	3.30	3.92	4.4	5.3			
16/05/16	0815-0825	26/Cloudy	Surface	1.0	26.0	28.1	28.2	6.87	6.88	6.88	96.1	96.3	3.87	3.92	5.4	5.1	4.9	
			Middle	10.1	25.8	28.3	28.3	6.89	6.95	96.4	99.0	3.96	3.72	5.1	5.3			
			Bottom	19.2	25.7	28.5	28.5	7.13	7.12	102.8	102.7	3.55	3.56	5.5	5.3			
18/05/16	0936-0950	25/Cloudy	Surface	1.0	24.7	29.3	29.4	7.11	7.45	7.39	102.6	106.0	3.57	2.79	4.3	3.5	4.3	
			Middle	10.2	24.7	29.3	29.4	6.94	7.33	104.0	104.3	3.63	3.11	4.3	4.7			
			Bottom	19.3	24.6	29.5	29.6	6.96	6.84	104.6	103.3	3.65	3.53	4.7	4.8			
20/05/16	1037-1051	24/Cloudy	Surface	1.0	24.8	29.4	29.5	6.85	7.32	7.34	104.1	104.5	3.48	2.54	4.3	3.6	4.4	
			Middle	10.1	24.8	29.7	29.7	7.29	7.36	105.5	105.1	3.57	3.03	3.9	4.6			
			Bottom	19.1	24.7	29.8	29.8	7.15	7.12	102.1	101.7	3.38	3.42	4.6	5.2			

Mid-Ebb Tide

Monitoring Station : TKO-C1

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)			
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Value	Average	Depth-average	Value	Average
23/05/16	1200-1216	28/Cloudy	Surface	1.0	28.4	28.4	7.68	7.71	7.59	109.2	109.6	3.13	3.09	3.9	4.2	3.7	3.9	4.2
					28.3	7.74	110.0	3.16		4.1								
			Middle	10.1	28.6	28.6	7.44	7.47	7.29	105.8	106.3	3.13	2.84	3.9	4.2	4.0		
					28.5	7.50	106.7	2.90		3.8								
			Bottom	19.2	28.8	28.8	7.27	7.29	7.29	103.5	103.8	3.40	3.34	4.8	4.8	4.3		
					28.8	7.31	104.1	3.45		5.2								
25/05/16	1308-1323	28/Cloudy	Surface	1.0	28.7	28.8	6.73	6.77	6.84	97.6	98.2	2.31	2.27	3.6	3.6	3.6	3.6	3.6
					28.8	6.81	98.7	2.35		3.5								
			Middle	10.1	29.0	29.0	6.87	6.91	7.10	99.5	100.1	3.04	3.24	4.4	4.4	3.9		
					28.9	6.95	100.7	3.18		4.8								
			Bottom	19.2	29.1	29.2	7.08	7.10	7.10	102.6	102.9	3.61	3.57	5.5	5.5	5.4		
					29.3	7.11	103.1	3.65		5.5								
27/05/16	1515-1529	27/Cloudy	Surface	1.0	29.7	29.8	6.96	6.98	6.94	99.5	99.7	2.93	2.88	4.0	4.0	4.0	4.0	4.0
					29.8	6.99	99.9	2.97		3.9								
			Middle	10.1	29.6	29.6	6.93	6.91	7.04	99.1	98.7	3.26	3.49	4.8	4.8	5.2		
					29.5	6.88	98.3	3.55		4.3								
			Bottom	19.1	29.6	29.7	7.02	7.04	7.04	100.1	100.5	3.33	3.28	6.5	6.5	7.9		
					29.8	7.06	100.8	3.37		5.1								
30/05/16	1738-1753	31/Cloudy	Surface	1.0	28.4	28.4	7.31	7.28	7.21	107.3	106.8	2.72	2.69	4.1	4.1	4.0	4.1	4.1
					28.3	7.24	106.3	2.75		4.1								
			Middle	10.1	28.5	28.6	7.11	7.14	7.14	104.3	104.8	3.32	3.28	4.5	4.5	4.6		
					28.7	7.17	105.2	3.36		4.4								
			Bottom	19.2	28.5	28.5	7.12	7.10	7.10	104.4	104.2	3.71	3.68	5.4	5.4	5.2		
					28.4	7.08	103.9	3.73		5.6								

Mid-Ebb Tide



東業 德 勤 測 試 顧 問 有 限 公 司
ETS-TEST CONSULT LIMITED

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)	Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Suspended Solids (mg/L)		
					Value	Average	Value	Average	Depth-average	Value	Average	Value	Average	Depth-average	Value	Average	Depth-average
04/05/16	1048-1103	25/Cloudy	Surface	22.8	28.6	28.7	7.38	7.41	7.26	100.8	101.2	2.58	2.62	3.8	4.0	4.0	
			Middle	22.7	28.5	28.6	7.09	7.12	7.16	96.9	97.3	2.65	2.53	4.2	4.1		
			Bottom	22.7	28.7	28.3	7.14	7.21	7.21	97.6	98.6	2.48	3.00	4.0	3.9		
06/05/16	1219-1234	28/Cloudy	Surface	23.2	28.8	28.7	7.16	7.20	7.16	98.2	98.7	2.27	2.26	3.4	3.4	3.4	
			Middle	23.1	28.9	29.0	7.08	7.12	7.16	99.2	97.7	2.24	2.50	3.4	3.2		
			Bottom	23.1	29.1	29.1	7.15	7.21	7.21	98.6	98.9	2.54	2.21	3.6	3.6		
09/05/16	1419-1435	30/Cloudy	Surface	23.9	29.3	29.2	7.09	7.12	7.15	99.0	99.4	3.34	3.31	4.7	4.8	4.9	
			Middle	23.8	29.2	29.3	7.14	7.19	7.29	99.7	100.5	3.27	3.18	4.9	4.6		
			Bottom	23.6	29.3	29.4	7.20	7.29	7.29	100.6	102.0	3.20	3.82	5.0	5.2		
11/05/16	1640-1700	29/Cloudy	Surface	24.2	29.4	29.4	7.30	7.26	7.26	101.7	99.8	3.80	3.28	5.0	4.5	4.9	
			Middle	24.1	29.5	29.5	7.06	7.09	7.12	99.4	99.8	3.31	3.15	3.9	4.9		
			Bottom	23.9	29.5	29.6	7.11	7.16	7.26	100.1	100.7	3.24	3.79	4.7	5.4		
13/05/16	1735-1750	27/Cloudy	Surface	23.7	29.1	29.2	7.17	7.16	7.19	101.9	101.8	3.81	3.38	5.0	4.6	4.7	
			Middle	23.7	29.2	29.2	7.24	7.22	7.22	99.6	99.9	3.77	3.24	5.7	4.7		
			Bottom	23.6	29.3	29.3	7.14	7.03	7.03	100.1	100.8	3.40	3.76	4.8	4.9		
16/05/16	0940-1000	26/Cloudy	Surface	26.2	27.9	28.0	7.01	7.19	7.11	103.8	103.7	3.27	3.28	5.2	4.9	5.0	
			Middle	26.0	28.1	28.2	7.20	7.03	7.23	103.6	94.0	3.29	3.37	4.6	5.1		
			Bottom	25.8	28.3	28.4	7.04	6.93	6.93	94.1	92.4	3.36	3.60	5.0	5.2		
18/05/16	1043-1058	25/Cloudy	Surface	24.8	29.2	29.3	6.94	7.19	7.23	92.3	102.1	3.61	2.29	3.2	3.1	3.8	
			Middle	24.7	29.0	29.1	7.16	7.27	7.27	102.5	103.2	2.26	2.92	4.0	4.1		
			Bottom	24.6	29.3	29.4	7.25	7.15	7.15	102.9	101.5	2.89	3.12	4.1	4.4		
20/05/16	1205-1219	24/Cloudy	Surface	24.7	29.4	29.3	7.17	7.45	7.49	101.8	106.5	3.08	2.11	3.1	3.0	3.6	
			Middle	24.6	29.5	29.4	7.13	7.54	7.49	101.2	106.6	3.15	2.86	2.8	3.9		
			Bottom	24.6	29.3	29.3	7.4	7.4	7.4	106.1	105.7	2.07	3.09	3.7	4.0		

Mid-Ebb Tide

Monitoring Station : TKO-M4

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Monitoring Depth (m)		Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Dissolved Oxygen Saturation (%)			Turbidity (NTU)			Suspended Solids (mg/L)		
			Surface	Bottom		Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average	Value	Average
23/05/16	1332-1350	28/Cloudy	1.0	Surface	25.1	28.4	7.84	7.82	111.4	109.6	2.96	2.99	4.1	4.2	4.0				
					25.0	28.5	7.79	7.91	107.7	112.4	3.02	2.73	4.2	3.8					
					24.9	28.5	7.89	7.92	112.1	107.9	2.76	3.04	4.1	4.1					
25/05/16	1425-1440	28/Cloudy	1.0	Surface	25.9	29.2	7.58	7.30	106.4	105.8	2.42	2.38	3.1	3.3	3.7				
					25.9	29.3	7.55	7.17	107.5	103.9	3.00	2.68	3.5	3.4					
					25.8	29.2	7.34	7.20	105.2	104.2	2.33	3.01	3.4	4.6					
27/05/16	1630-1645	27/Cloudy	1.0	Surface	26.7	30.2	7.19	7.16	103.8	102.5	2.72	2.68	4.0	3.9	4.3				
					26.7	30.2	7.25	7.27	104.2	104.0	3.07	3.10	4.6	4.5					
					26.6	30.0	7.28	7.05	101.3	100.9	3.13	3.27	4.4	4.6					
30/05/16	1856-1910	31/Cloudy	1.0	Surface	27.8	28.2	7.08	7.31	106.9	107.3	3.30	3.12	4.5	3.9	4.4				
					27.7	28.6	7.02	7.09	100.5	104.0	3.24	3.16	4.6	4.3					
					27.6	28.7	7.28	7.21	107.7	105.8	3.16	3.42	4.1	5.1					




Appendix I


D3


Graphical Plots of Impact Marine Water Quality Monitoring Data

Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

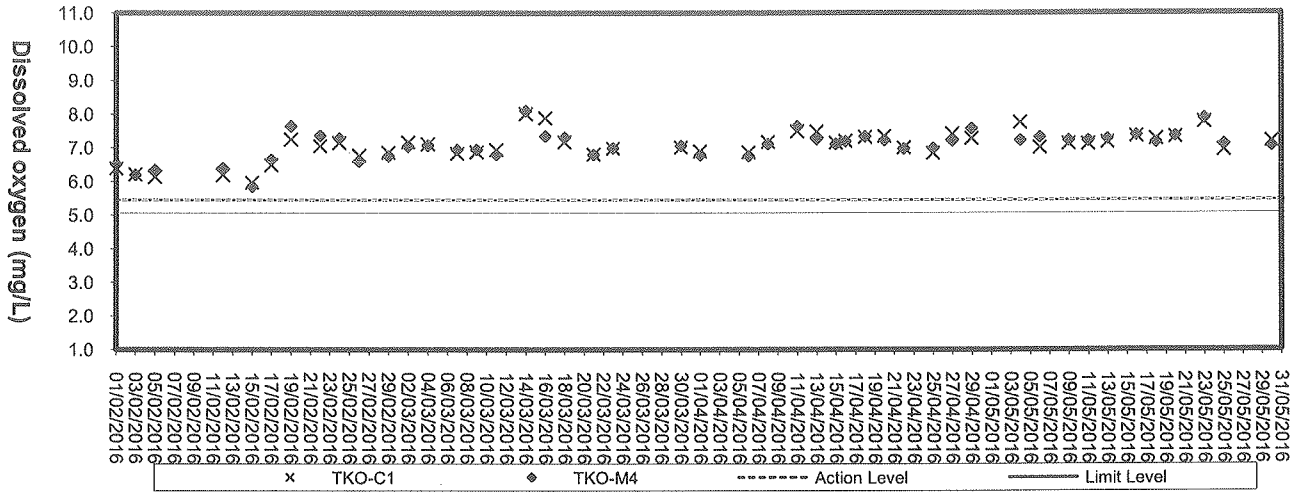


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

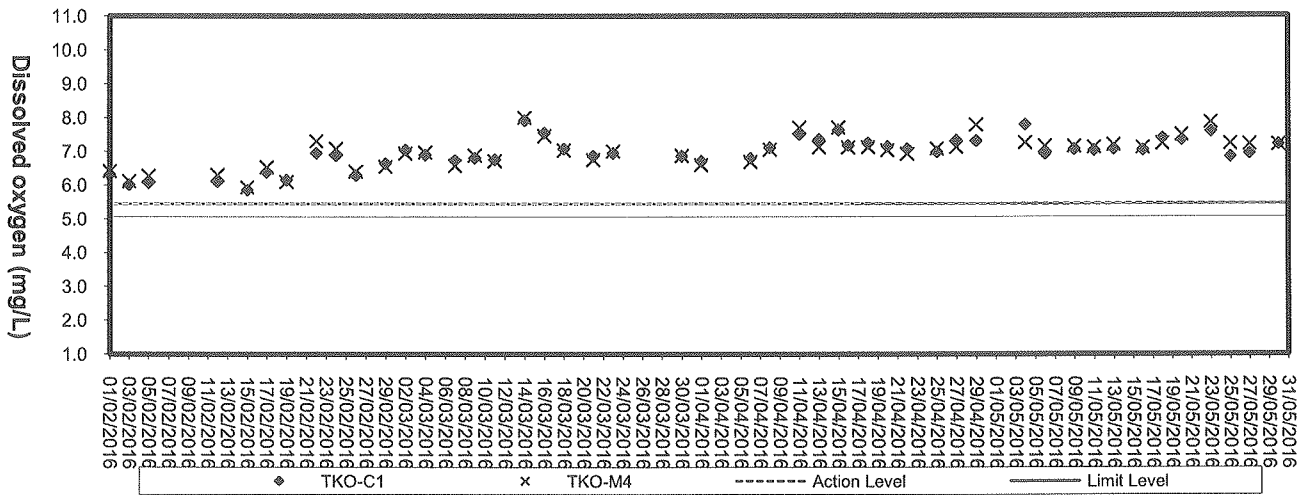





Dissolved Oxygen (Bottom) at Mid-Flood Tide

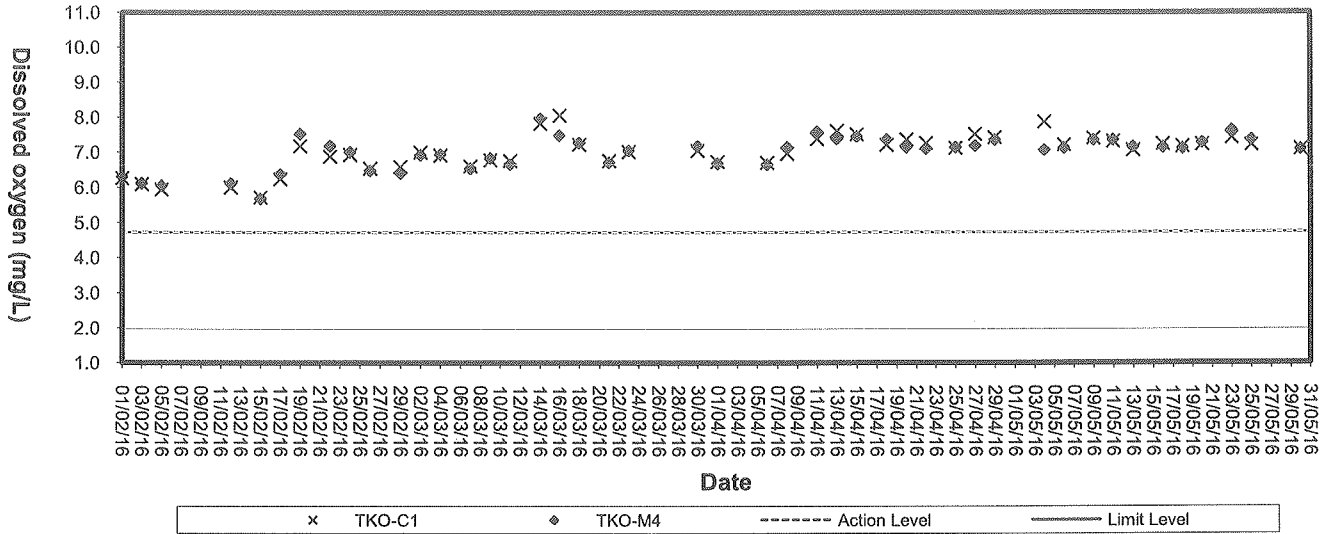


Dissolved Oxygen (Bottom) at Mid-Ebb Tide

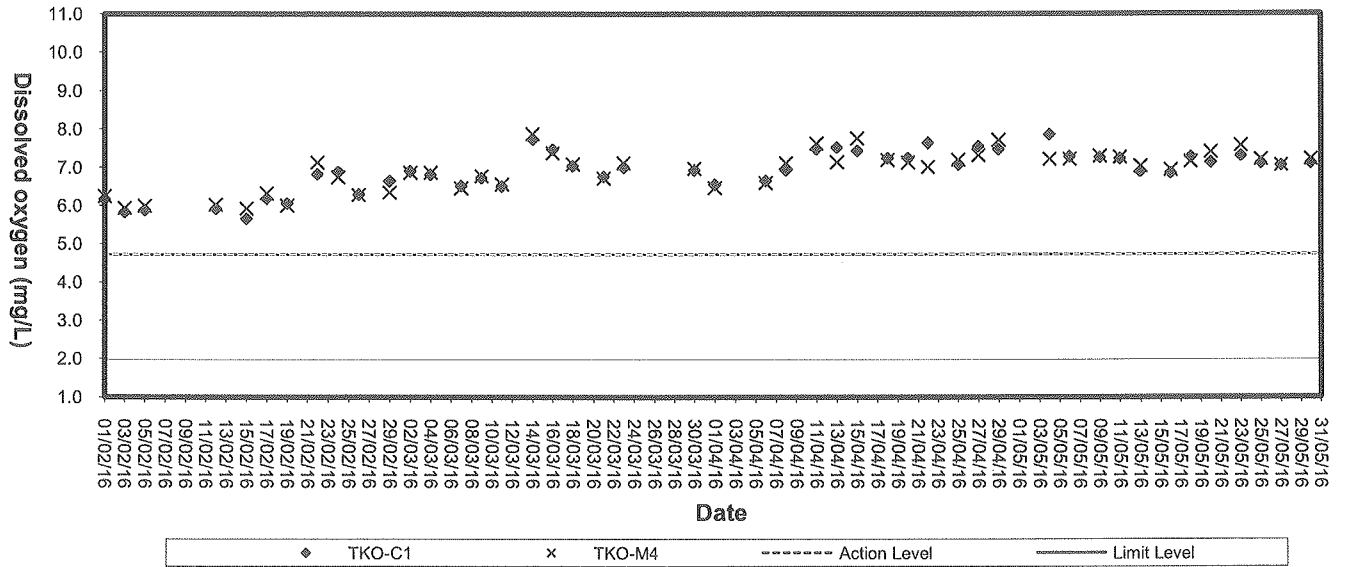





Turbidity (Depth-average) at Mid-Flood Tide

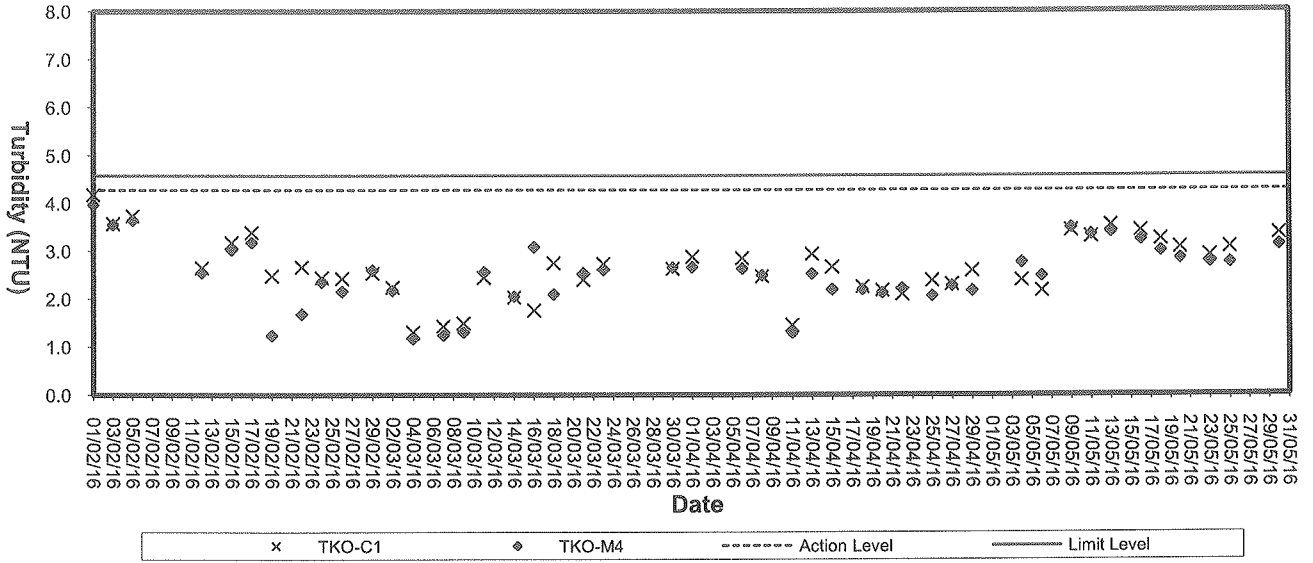


Turbidity(Depth-average) at Mid-Ebb Tide

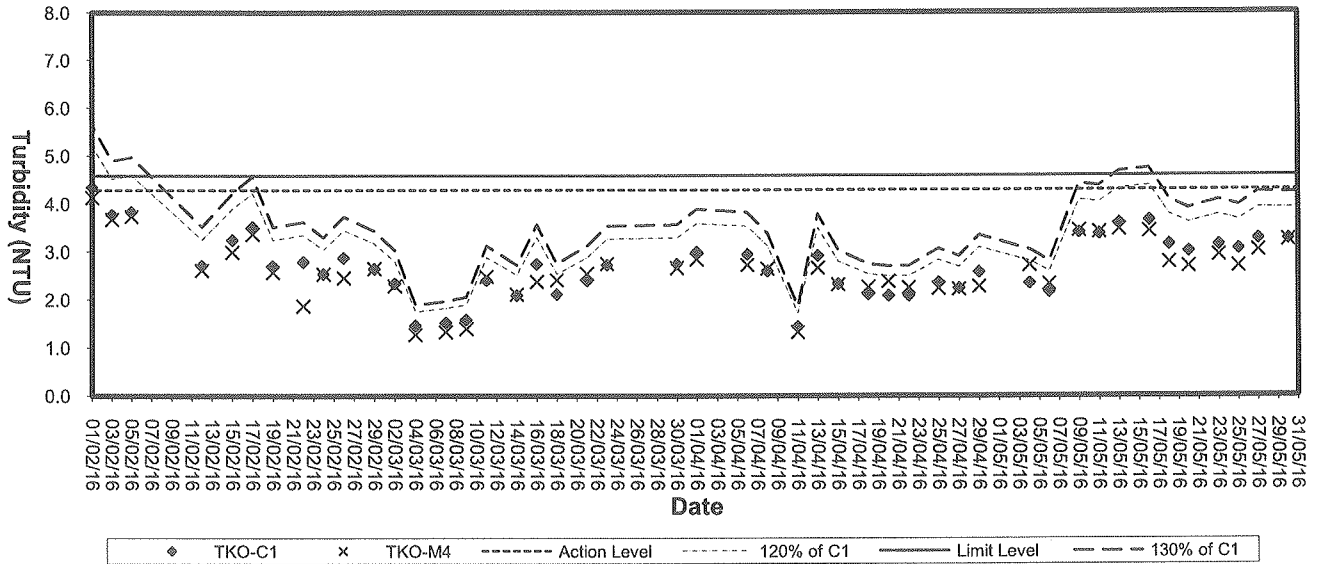





Suspended solids (Depth-average) at Mid-Flood Tide

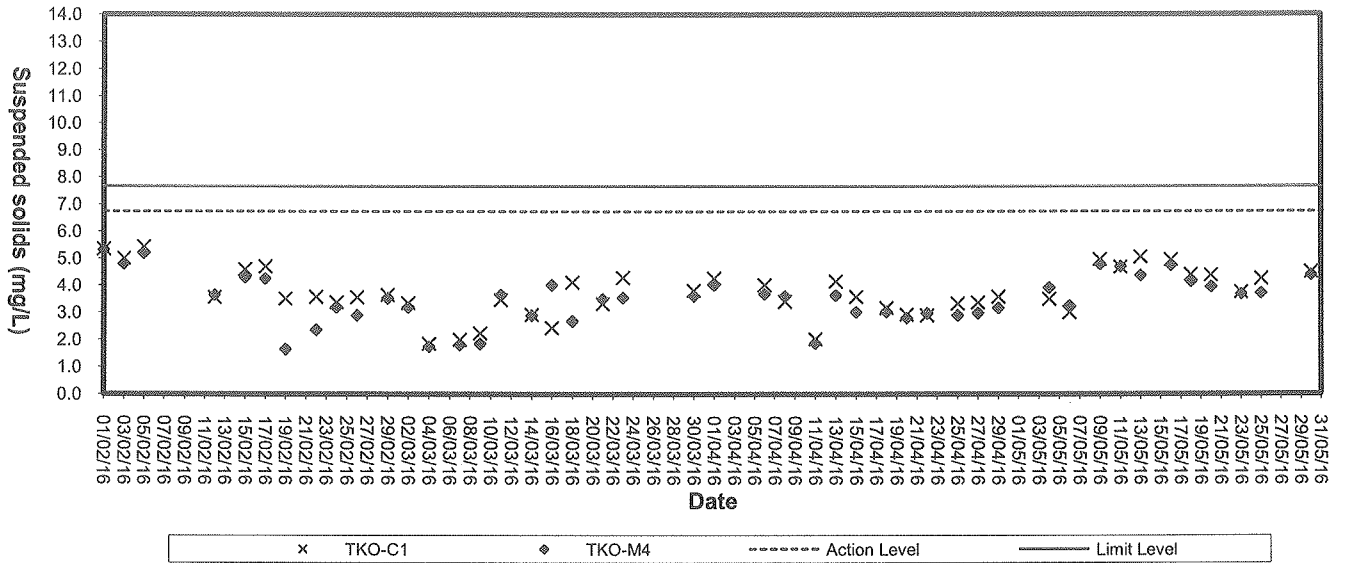

Suspended Solids (Depth-average) at Mid-Ebb Tide

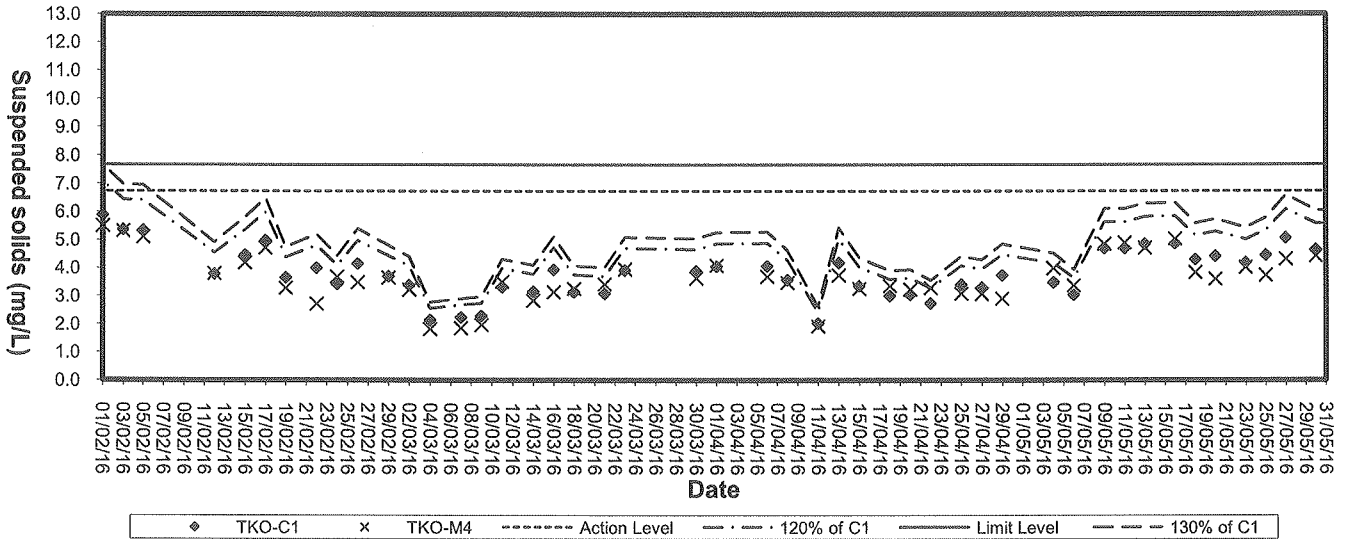



Appendix I

E

Weather Condition

Daily Extract of Meteorological Observations, May 2016 – Tseung Kwan O

Day	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Total Rainfall (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)					
01	***	22.5	21.5	19.6	20.8	96	1.5	350	5.3
02	***	25.9	23.9	22.3	23.5	98	1.0	010	3.5
03	***	31.1	25.8	22.1	24.1	91	26.0	170	5.0
04	***	28.6	25.0	22.0	23.6	92	0.0	070	3.6
05	***	30.2	27.3	24.8	25.4	90	0.0	180	5.1
06	***	29.8#	27.2	25.6#	25.5	91	0.0	180	4.8
07	***	30.9	27.9	25.5	25.7	88	0.0	190	5.0
08	***	30.6#	28.1	26.4#	26.1	89	0.0	190	3.8
09	***	30.0	28.0	26.1	25.6	87	0.0	190	5.0
10	***	27.8	25.4	22.9	24.4	94	61.5	200	4.1
11	***	28.8	24.6	21.2	20.3	78	0.0	060	6.5
12	***	27.8	24.7	23.0	21.2	82	0.0	010	6.7
13	***	27.4	25.0	23.4	22.3	86	0.0	010	7.3
14	***	27.3	24.9	23.8	23.3	91	2.5	050	7.6
15	***	29.9	25.8	23.2	23.6	88	1.0	020	5.5
16	***	28.9	24.8	20.8	19.0	72	0.0	340	6.4
17	***	24.3	23.1	22.1	19.8	82	0.5	030	6.9
18	***	25.0	23.6	22.2	19.6	78	0.0	020	6.2
19	***	25.6	24.4	23.5	22.3	88	0.0	020	6.5
20	***	25.3	24.3	23.6	23.9	98	13.5#	010	5.0
21	***	28.6	25.5	24.0	24.7	96	0.0#	190	3.8
22	***	31.3	26.0	23.0	22.7	83	0.0	060	5.5
23	***	30.8	25.7	22.4	22.9	85	0.0	190	4.5
24	***	32.0	27.0	23.3	23.9	84	0.0	190	3.6
25	***	29.4	26.9	24.4	24.8	89	0.0	020	4.9
26	***	27.9	26.7	26.0	24.8	89	1.0	070	6.8
27	***	28.8	26.9	25.6	25.4	92	8.5	110	7.1
28	***	30.6	27.3	24.5	25.6	91	43.5	190	6.9
29	***	31.9	28.3	25.5	26.3	90	1.5	180	5.0
30	***	33.4#	29.3	26.7#	26.3	85	3.5	190	6.1
31	***	33.0#	29.9	27.6#	25.8	79	0.0	220	7.4

*** unavailable

data incomplete

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected



Appendix I

F

Event-Action Plans

EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

ET Leader	IC(E)	ER	Contractor
ACTION			

EVENT	ACTION LEVEL	LIMIT LEVEL	CONTRACTOR
<ol style="list-style-type: none"> Exceedance for one sample 	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures Inform ER, IC(E) and Contractor Repeat measurement to confirm finding Increase monitoring frequency to daily 	<ol style="list-style-type: none"> Check monitoring data submitted by the ET Check contractor's working method 	<ol style="list-style-type: none"> Notify Contractor
<ol style="list-style-type: none"> Exceedance for two or more consecutive samples 	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures Inform IC(E) and Contractor Repeat measurements to confirm finding Increase monitoring frequency to daily Discuss with IC(E) and Contractor on remedial actions If exceedance continues, arrange meeting with IC(E) and ER. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> Check monitoring data submitted by the ET Check the Contractor's working method Discuss with ET and Contractor on possible remedial measures Advise the ER on the effectiveness of the proposed remedial measures Supervise implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify the Contractor Ensure remedial measures properly implemented
<ol style="list-style-type: none"> Exceedance for one sample 	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures Inform ER, Contractor and EPD Repeat measurement to confirm finding Increase monitoring frequency to daily Assess the effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results 	<ol style="list-style-type: none"> Check monitoring data submitted by the ET Check Leader Discuss with ET and Contractor on possible remedial measures Advise the ER on the effectiveness of the proposed remedial measures Supervise implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify the Contractor Ensure remedial measures properly implemented

1. Rectify any unacceptable practise
 2. Amend working methods if appropriate

1. Submit proposals for remedial actions to IC(E) within 3 working days of notification
 2. Implement the agreed proposals
 3. Amend proposal if appropriate

1. Take immediate action to avoid further exceedance
 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification
 3. Implement the agreed proposals
 4. Amend proposal if appropriate.

EVENT/ACTION PLAN FOR AIR QUALITY EXCEEDANCE

EVENT	ACTION			Contractor
	ET Leader	IC(E)	ER	
<p>2. Exceedance for two or more consecutive samples</p>	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures 2. Notify IC(E), ER, EPD and Contractor 3. Repeat measurement to confirm finding 4. Increase monitoring frequency to daily 5. Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented 6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken 7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results 8. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET and Contractor on the potential remedial actions 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly 3. Supervise the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. In consultation with the IC(E), agree with the Contractor on the remedial measures to be implemented 4. Ensure remedial measures are properly implemented 5. If exceedances continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedances 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant activity of works as determined by the ER until the exceedance is abated

EVENT/ACTION PLAN FOR NOISE EXCEEDANCE

EVENT	ACTION			
	ET Leader	IC(E)	ER	Contractor
Action Level	<ol style="list-style-type: none"> 1. Notify the IC(E) and the Contractor. 2. Carry out investigation. 3. Report the results of investigation to the IC(E) and the Contractor. 4. Discuss with the Contractor and formulate remedial measures. 5. Increase monitoring frequency to check mitigation effectiveness 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET. 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly. 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analysed noise problem. 4. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IC(E). 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Notify the IC(E), the ER, the EPD and the Contractor. 2. Identify source. 3. Repeat measurement to confirm findings. 4. Increase monitoring frequency. 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. 6. Inform the IC(E), the ER and the EPD the causes & actions taken for the exceedances. 7. Assess effectiveness of Contractor's remedial actions and keep the IC(E), the EPD and the ER informed of the results 8. If exceedance due to the construction works stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Discuss amongst the ER, the ET Leader and the Contractor on the potential remedial actions. 2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly. 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analysed noise problem. 4. Ensure remedial measures are properly implemented. 5. If exceedances continue, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedances is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification. 3. Implement the agreed proposals. 4. Resubmit proposals if problem still not under control. 5. Stop the relevant activity of works as determined by the ER until the exceedances is abated.

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
<p>Action level being exceeded by one sampling day</p>	<ol style="list-style-type: none"> 1. Identify source(s) of impact; 2. Repeat in-situ measurement to confirm findings; 3. Notify Contractor in writing within 24 hours of identification of the exceedance 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with Contractor if exceedance is due to the construction works within 4 working days 8. Repeat measurement on next day of exceedance if exceedance is due to the construction works 	<ol style="list-style-type: none"> 1. Notify the ER and IEC in writing within 24 hours of identification of exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Submit investigation report to IEC and ER within 3 working days of the identification of an exceedance 5. Consider changes of working method if exceedance is due to the construction works 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER if exceedance is due to the construction works within 4 working days of identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Require contractor to propose remedial measures for the analysed problem if related to the construction works 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the mitigation measure 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures 4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly 5. Supervise the implementation of mitigation measures

EVENT AND ACTION PLAN FOR WATER QUALITY

Event	ACTION			
	ET Leader	Contractor	ER	IEC
<p>Action level being exceeded by more than one consecutive sampling days</p>	<ol style="list-style-type: none"> 1. Identify source(s) of impact; 2. Repeat in-situ measurement to confirm findings 3. Notify Contractor in writing within 24 hours of identification 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with IEC and Contractor within 4 working of identification of an exceedance 8. Ensure mitigation measures are implemented; 9. Prepare to increase the monitoring frequency to daily; 10. Repeat measurement on next day of exceedance. 	<ol style="list-style-type: none"> 1. Notify IEC and ER in writing within 24 hours of identification of exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Submit the results of the investigation to IEC and ER within 3 working days of identification of an exceedance 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of the identification of the exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Require contractor to propose remedial measures for the analysed problem if related to the construction works 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the mitigation measure 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures. 4. Review contractor's mitigation measures whenever necessary to ensure their effectiveness and advise the ER accordingly 5. Assess the effectiveness of the implemented mitigation measures.

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> 1. Repeat in-situ measurement to confirm findings; 2. Identify source(s) of impact; 3. Notify Contractor in writing within 24 hours of identification of the exceedance 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with IEC, ER and Contractor within 4 working of identification of an exceedance 8. Ensure mitigation measures are implemented; 9. Increase the monitoring frequency to daily until no exceedance of Limit Level. 	<ol style="list-style-type: none"> 1. Notify IEC and ER in writing; within 24 hours of the identification of the exceedance 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance 6. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days of the identification of an exceedance 7. Implement the agreed mitigation measures within reasonable time scale 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Request Contractor to critically review the working methods; 4. Ensure remedial measures are properly implemented 5. Assess the effectiveness of the implemented mitigation measures. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ET, ER and Contractor on the mitigation measures. 4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly. 5. Assess the effectiveness of the implemented mitigation measures

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE

Event	ACTION			IEC
	ET Leader	Contractor	ER	
Limit Level being exceeded by more than one consecutive sampling days	<ol style="list-style-type: none"> 1. Repeat in-situ measurement to confirm findings; 2. Identify source(s) of impact; 3. Notify Contractor in writing within 24 hours of identification of the exceedance 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Carry out investigation 6. Report the results of investigation to the Contractor within 3 working days of identification of exceedance and advise contractor if exceedance is due to contractor's construction works 7. Discuss mitigation measures with IEC, ER and Contractor; 8. Ensure mitigation measures are implemented; 9. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days. 	<ol style="list-style-type: none"> 1. Notify ER and IEC in writing within 24 hours of the identification of the exceedance and 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 8. Submit the results of the investigation to IEC and ER within 3 working days of the identification of an exceedance 5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 4 working days; 6. Implement the agreed mitigation measures within reasonable time scale 7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities. 	<ol style="list-style-type: none"> 1. Notify EPD and other relevant governmental agencies in writing within 24 hours of identification of exceedance 2. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 3. Request Contractor to critically review the working methods; 6. Ensure remedial measures are properly implemented 4. Assess the effectiveness of the implemented mitigation measures; 5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit Level. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET 2. Confirm ET assessment if exceedance is due / not due to the works 3. Discuss with ER, ET and Contractor on the mitigation measures. 4. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly. 5. Assess the effectiveness of the implemented mitigation measures.



Appendix I


G

Works Programme

Master Programme of Contract No. CV/2013/06 - Handling of Surplus Public Fill

Site Location : Tseung Kwan O Area 137 Fill Bank

ID	Activity	Original Duration	Start	Finish
A1150	Take Over	0	23-Jan-14	
A1170	Operation	1100	23-Jan-14	26-Jan-17
A1370	Hand Over to CEDD	0		26-Jan-17
Stage A1 Construction of New Office				
A1080	Submission	120	28-Nov-13	27-May-14
A1090	Approval by Engineer	30	28-Nov-13	27-Dec-13
A1100	Installation	7	28-Dec-13	03-Jan-14
A1110	Hand Over to Engineer	64	23-Jan-14	27-May-14
A1110	Hand Over to Engineer	0		27-May-14
Stage A1 Surveillance System				
A1190	Submission	120	28-Nov-13	27-May-14
A1190	Submission	30	28-Nov-13	27-Dec-13
A1200	Approval by Engineer	7	28-Dec-13	03-Jan-14
A1210	Installation	64	23-Jan-14	27-May-14
A1230	Hand Over to Engineer	0		27-May-14



Appendix I

H

Weekly ET's Site Inspection Record



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 4/5/16




Time : 10:10

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 26°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	C. W. CHAN	Eric Chan	Mark Tin Wan
Title	Low / Tko	EO	ET



Implementation Stages*		Remark
Fugitive Dust Emission		
✓		Dust control / mitigation measures shall be provided to prevent dust nuisance.
✓		A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.
✓		Water sprays shall be provided and used to dampen materials.
✓		Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.
✓		All vehicles shall be restrict to a maximum speed of 10 km per hour.
✓		Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.
✓		The designated site main haul road shall be paved or regular watering.
✓		Frequent watering of work site shall be at least three times per day.
✓		Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.
✓		Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.
✓		All plant and equipment should be well maintained e.g. without black smoke emission.
✓		Open burning should be prohibited.
✓		The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.
✓		Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.
✓		When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.
✓		The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.
✓		The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.
✓		Approval or exemption Non-road Mobile Machinery (NRM/M) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCC Cap.311).
Noise Impact		
✓		The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.
✓		Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.
✓		Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.
✓		Air compressors and hand held breakers should have noise labels.
✓		Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.
✓		Noisy equipment and mobile plant shall always be site away from NSRs.

	Implementation Stages*		Remark
	Yes	No N/A	
Water Quality			
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	✓		Item 2
The permanent drainage channels should have sediment basin, traps and baffles and maintain property.	✓		
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	✓		
Manholes should be covered and sealed.	✓		
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	✓		
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	✓		
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	✓		
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	✓		
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓		
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓		
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	✓		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	✓		
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	✓		
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	✓		
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	✓		
Oil interceptor shall be provided at work shop.	✓		
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	✓		
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	✓		
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	✓		
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	✓		
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	✓		
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	✓		
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	✓		
A waste collection vessel shall be deployed to remove floating debris.	✓		




Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
Landscape and Visual				
▪ The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	✓			
▪ The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	✓			
▪ Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	✓			
▪ The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	✓			
Other Environmental Factors				
▪ C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	✓			
▪ Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	✓			
▪ Any unused materials or those with remaining functional capacity should be recycled and stored properly.	✓			
▪ All generators, fuel and oil storage are within bundle areas.	✓			
▪ Oil leakage from machinery, vehicle and plant is prevented.	✓			
▪ The Environmental Permit should be displaced conspicuously on site.	✓			
▪ Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	✓			
▪ To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	✓			

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 2 on 27/04/2016, no stagnant water was found on the road near Zone A1.	--	160504_001	No	--
2	Mud was noted on the ground near wheel maintenance area.	To clear the mud as soon as possible.	160504_002	Yes	11/05/16
3	Rubbish, such as plastic bag and paper box, were found discarded inside and beside the drainage channel near site entrance.	To collect and dispose of the rubbish properly.	160504_003	Yes	11/05/16

Remark

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		04 May 2016

Photos

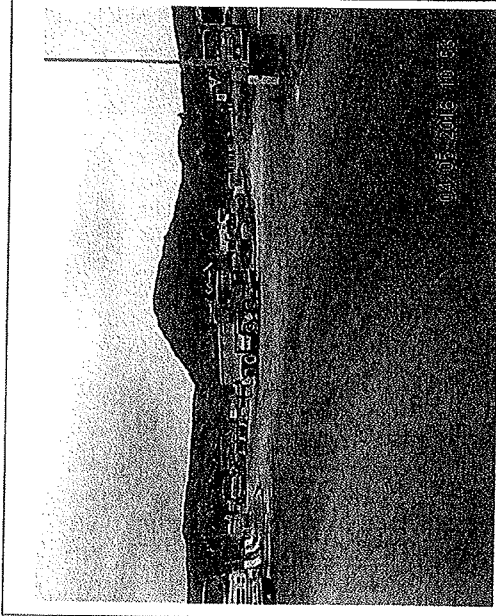


Photo 160504_001 (Zone A1) (Improved)

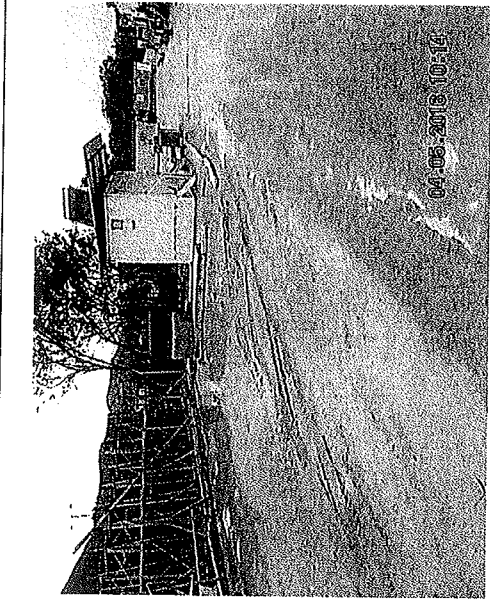


Photo 160504_002 (Wheel maintenance area)



Photo 160504_003 (Site entrance)



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 11.5.16

Time : 10:40

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 25°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	O. W. CHAN	Eric Wan	Ty Chygho
Title	100183	EO	E.T

Environmental Checklist		Implementation Stages*		Remark
		Yes	No / N/A	
Fugitive Dust Emission				
▪	Dust control / mitigation measures shall be provided to prevent dust nuisance.	√		
▪	A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	√		
▪	Water sprays shall be provided and used to dampen materials.	√		
▪	Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	√		
▪	All vehicles shall be restricted to a maximum speed of 10 km per hour.	√		
▪	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	√		
▪	The designated site main haul road shall be paved or regular watering.	√		
▪	Frequent watering of work site shall be at least three times per day.	√		
▪	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	√		
▪	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√		
▪	All plant and equipment should be well maintained e.g. without black smoke emission.	√		
▪	Open burning should be prohibited.	√		
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
▪	When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√		
▪	The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	√		
▪	The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√		
▪	Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	√		
Noise Impact				
▪	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	√		
▪	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	√		
▪	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√		
▪	Air compressors and hand held breakers should have noise labels.	√		
▪	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	√		
▪	Noisy equipment and mobile plant shall always be site away from NSRs.	√		

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

	Implementation Stages*	Remark
Water Quality		
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√	Item 3
The permanent drainage channels should have sediment basin, traps and baffles and maintain property.	√	
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√	
Manholes should be covered and sealed.	√	
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√	
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√	
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√	
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√	
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√	
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√	
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√	
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√	
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent silt run-off from entering public road drains.	√	
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√	
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√	
Oil interceptor shall be provided at work shop.	√	
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√	
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√	
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√	
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√	
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√	
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√	
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√	
A waste collection vessel shall be deployed to remove floating debris.	√	

Environmental Checklist		Implementation Stages*			Remark
		Yes	No	N/A	
Landscape and Visual					
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√			
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√			
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√			
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√			
Other Environmental Factors					
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√			
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√			
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√			
▪	All generators, fuel and oil storage are within bundle areas.	√			
▪	Oil leakage from machinery, vehicle and plant is prevented.	√			
▪	The Environmental Permit should be displaced conspicuously on site.	√			
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√			
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√			



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 2 on 04/05/2016, mud noted on the ground near wheel maintenance area was cleared.	--	160511_001	No	--
2	Follow up action to item 3 on 04/05/2016, rubbish, such as plastic bag and paper box, discarded inside and beside the drainage channel near site entrance was cleared.		160511_002	No	
3	Muddy water was found accumulated besides the drainage channel near CP5.	To clear the accumulated muddy water properly.	160511_003	Yes	18/05/16
4	Some sand bags provided along the drainage channel near CP5 were broken.	To replace the broken sand bags by new ones.	160511_003	Yes	18/05/16

Remark

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		11 May 2016

Photos

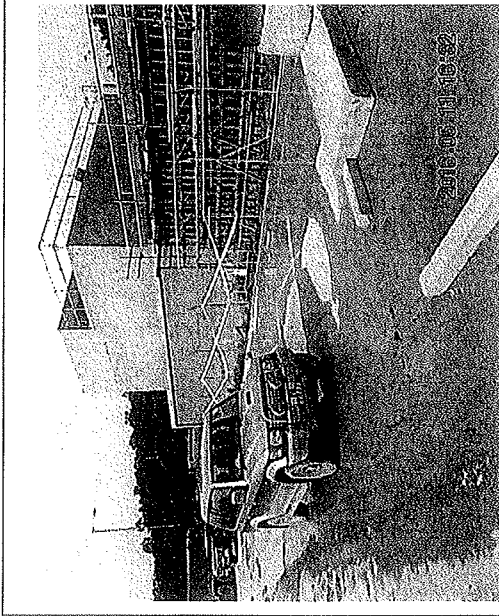


Photo 160511_001 (Wheel maintenance area)(Improved)

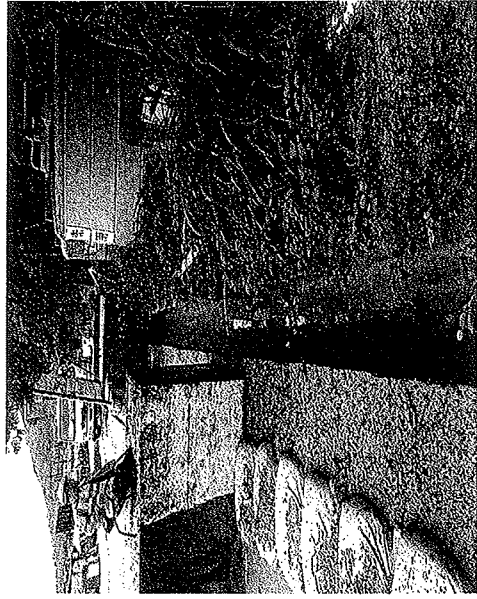


Photo 160511_002 (Site entrance) (Improved)

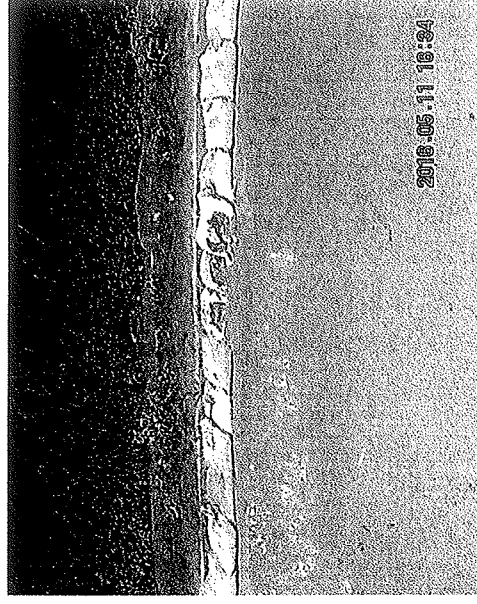





Photo 160511_003 (Near CP5)



CEDD Contract No.: CV/2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 18.5.16
 Time : 9:30
 Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
 Wind : Calm / Light / Breeze / Strong
 Temperature : 25°C
 Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:		 P.P.	
Name:	C.L. HON	LAU WAH FAI WAFFERY	E.T.
Title	AWOW / P(3) (1)	SENIOR ENGINEER ENVIRONMENTAL SUPERVISOR	E.T.



Environmental Checklist		Implementation Stages*		Remark
		Yes	No / N/A	
Fugitive Dust Emission				
▪	Dust control / mitigation measures shall be provided to prevent dust nuisance.	√		
▪	A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	√		
▪	Water sprays shall be provided and used to dampen materials.	√		
▪	Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	√		
▪	All vehicles shall be restrict to a maximum speed of 10 km per hour.	√		
▪	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	√		
▪	The designated site main haul road shall be paved or regular watering.	√		
▪	Frequent watering of work site shall be at least three times per day.	√		
▪	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	√		
▪	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√		
▪	All plant and equipment should be well maintained e.g. without black smoke emission.	√		
▪	Open burning should be prohibited.	√		
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
▪	When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√		
▪	The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	√		
▪	The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√		
▪	Approval or exemption Non-road Mobile Machinery (NRM/M) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	√		
Noise Impact				
▪	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	√		
▪	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	√		
▪	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√		
▪	Air compressors and hand held breakers should have noise labels.	√		
▪	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	√		
▪	Noisy equipment and mobile plant shall always be site away from NSRs.	√		

		Implementation Stages*		Remark
		Yes	No	
Water Quality				
■	Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√		
■	The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√		
■	Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√		
■	Manholes should be covered and sealed.	√		
■	Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√		
■	A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√		
■	A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√		
■	The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√		
■	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√		
■	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√		
■	Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√		
■	A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√		
■	The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√		
■	Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√		
■	Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√		
■	Oil interceptor shall be provided at work shop.	√		
■	Tipping hails enclosed with top and 3-side to prevent spillage of material into marine water.	√		
■	The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√		
■	All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√		
■	Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√		
■	Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√		
■	The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√		
■	Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√		Item 3
■	A waste collection vessel shall be deployed to remove floating debris.	√		



Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Environmental Checklist		Implementation Stages*		Remark
		Yes	No / N/A	
Landscape and Visual				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√		
Other Environmental Factors				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√		
▪	All generators, fuel and oil storage are within bundle areas.	√		
▪	Oil leakage from machinery, vehicle and plant is prevented.	√		
▪	The Environmental Permit should be displaced conspicuously on site.	√		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√		



CEDD Contract No.: CV2013/06

Handling of Surplus Public Fill (2014-2016) - Tseung Kwan O Area 137 Fill Bank

Inspection Date : 25/5/16




Time : 10:00

Weather : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy

Wind : Calm / Light / Breeze / Strong

Temperature : 24°C

Humidity : High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contractor	ET
Signature:			
Name:	HON CHUNG LUN	Eric Wan	Mark Tei Wai
Title	AZOW/P3617	EO	E.T



		Implementation Stages*			Remark
		Yes	No	N/A	
Environmental Checklist					
Fugitive Dust Emission					
▪	Dust control / mitigation measures shall be provided to prevent dust nuisance.	✓			
▪	A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	✓			
▪	Water sprays shall be provided and used to dampen materials.	✓			
▪	Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	✓			
▪	All vehicles shall be restrict to a maximum speed of 10 km per hour.	✓			
▪	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	✓			
▪	The designated site main haul road shall be paved or regular watering.	✓			
▪	Frequent watering of work site shall be at least three times per day.	✓			
▪	Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	✓			
▪	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	✓			
▪	All plant and equipment should be well maintained e.g. without black smoke emission.	✓			
▪	Open burning should be prohibited.	✓			
▪	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	✓			
▪	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydros seeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	✓			
▪	When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	✓			
▪	The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	✓			
▪	The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	✓			
▪	Approval or exemption Non-road Mobile Machinery (NRM/M) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	✓			
Noise Impact					
▪	The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	✓			
▪	Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.	✓			
▪	Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	✓			
▪	Air compressors and hand held breakers should have noise labels.	✓			
▪	Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	✓			
▪	Noisy equipment and mobile plant shall always be site away from NSRs.	✓			

Implementation Stages*		Remark
Water Quality		
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	√	
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	√	
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√	
Manholes should be covered and sealed.	√	
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	√	Item 2
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	√	
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	√	
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	√	
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	√	
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√	
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	√	
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√	
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcore to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√	
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	√	
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	√	
Oil interceptor shall be provided at work shop.	√	
Tipping hails enclosed with top and 3-side to prevent spillage of material into marine water.	√	
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	√	
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	√	
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	√	
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	√	
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	√	
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	√	Item 1
A waste collection vessel shall be deployed to remove floating debris.	√	


Environmental Checklist		Implementation Stages*		Remark
		Yes	No	
Landscape and Visual				
▪	The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	√		
▪	The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	√		
▪	Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.	√		
▪	The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	√		
Other Environmental Factors				
▪	C&D waste sorted from mixed C&D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.	√		
▪	Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.	√		
▪	Any unused materials or those with remaining functional capacity should be recycled and stored properly.	√		
▪	All generators, fuel and oil storage are within bundle areas.	√		
▪	Oil leakage from machinery, vehicle and plant is prevented.	√		
▪	The Environmental Permit should be displaced conspicuously on site.	√		
▪	Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	√		
▪	To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	√		



Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Target Completion Date
1	Follow up action to item 3 on 18/05/2016, silt curtain near the tipping hall No.1 was still found damaged.	To repair the damaged silt curtain properly.	160525_001	Yes	01/06/16
2	Stagnant water was found under the container near wheel repairing area.	To clear the stagnant water to avoid mosquito breeding.	160525_002	Yes	01/06/16

Remark

Name	Title	Signature	Date
Linda Law	Senior Environmental Officer		25 May 2016

Photo

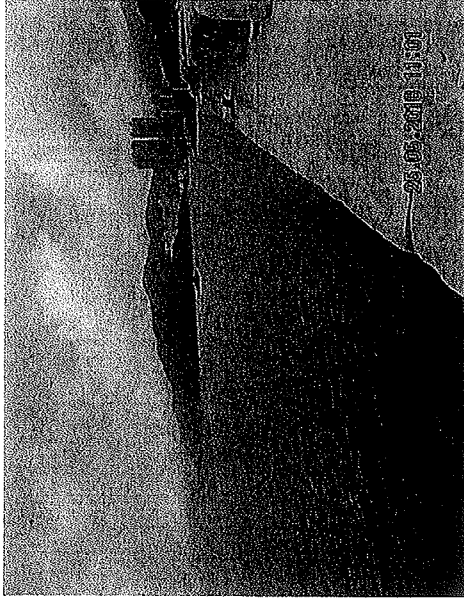


Photo 160525_001 (Silt curtain near tipping hall No.1)


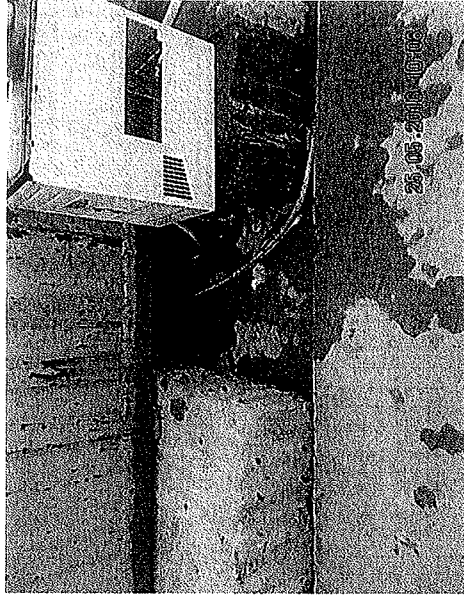


Photo 160525_002 (Near wheel repairing area)



Appendix I

I

Implementation Schedule of Mitigation Measures



	Location	Implementation Status			
		Implemented	Partially implemented	Not implemented	Not Applicable
Water Quality					
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	All areas	✓	✓		
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	All areas	✓			
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	All areas	✓			
Manholes should be covered and sealed.	All areas	✓			
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	All areas	✓			
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	Public fill stockpiling area	✓			
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.	C&DMSF	✓			
The stormwater intercepting system shall be effective to collect runoff and remove suspended solids before discharge.	All areas	✓			
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	Temporary Slopes	✓			
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	Temporary Slopes	✓			
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	All areas	✓	✓		
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	Wheel Washing facility	✓			
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	Wheel Washing facility	✓			
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	All areas	✓			
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas and work shop.	All areas	✓			
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	Barge Handling Area (BHA)	✓			
The barges shall be in right size such that adequate clearance is maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	Barge Handling Area (BHA)	✓			
All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.	Barge Handling Area (BHA)	✓			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	Along the seafront	✓			
Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.	Barge Handling Area (BHA)	✓			
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	Along the seafront	✓			
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	Along the seafront	✓	✓		
A waste collection vessel shall be deployed to remove floating debris.	Along the seafront	✓			



Appendix I

J

Site General Layout plan

- NOTES:
1. ALL DIMENSIONS REFER TO HINGE LINE UNLESS OTHERWISE SPECIFIED.
 2. ALL DIMENSIONS ARE IN METERS.
 3. ALL DIMENSIONS ARE IN METERS.
 4. EXISTING BARGE HANDLING AREA PAVED WITH ASPHALT. REFER TO DRAWING NO. FPM04-14.
 5. EXISTING CHANNELS AND OFFFALLS REFER TO DRAWING NO. FPM04-14.
 6. ALL EXISTING FEATURES SHOWN ON THIS DRAWING ARE TO REMAIN UNLESS OTHERWISE SPECIFIED. ANY CHANGES TO THE EXISTING FACILITIES SHOULD BE APPROVED BY THE CONTRACTOR IN WRITING PRIOR TO THE COMMENCEMENT OF WORK.

- LEGEND:
- SITE BOUNDARY
 - EXISTING BARGE HANDLING AREA
 - EXISTING MAINTENANCE LIFT
 - BUFFER ZONE
 - EXISTING CONCRETE ACCESS ROAD
 - EXISTING FENCING
 - PORTION BOUNDARY (INDICATIVE ONLY)
 - EXISTING WASTEWATER POND
 - W.P. (1)

ABBREVIATIONS:

- P.M.B. - PAVEMENT BOUNDARY
- M.S.F. - MOUND SURFACE FACILITY

NO.	DATE	DESCRIPTION	APPROVED BY
1	20.5.2013	ISSUED FOR TENDER	[Signature]
2	20.5.2013	ISSUED FOR TENDER	[Signature]
3	20.5.2013	ISSUED FOR TENDER	[Signature]
4	20.5.2013	ISSUED FOR TENDER	[Signature]

PROJECT NO. FM10068-6
 CONTRACT NO. CP2232/06
 PROJECT TITLE: HANDLING OF SURPLUS PUBLIC FILL (2014-2016)

DESIGNED BY: [Name]
 CHECKED BY: [Name]
 DATE: 20.5.2013


SCALE: 1:2,000
 SHEET NO. 45 OF 50

PROJECT TITLE: HANDLING OF SURPLUS PUBLIC FILL (2014-2016)
 DRAWING TITLE: TSEUNG KWAN O AREA 137 FILL BANK - GENERAL LAYOUT OF EXISTING FACILITIES

DESIGNED BY: [Name]
 CHECKED BY: [Name]
 DATE: 20.5.2013

SCALE: 1:2,000
 SHEET NO. 45 OF 50

PROJECT TITLE: HANDLING OF SURPLUS PUBLIC FILL (2014-2016)
 DRAWING TITLE: TSEUNG KWAN O AREA 137 FILL BANK - GENERAL LAYOUT OF EXISTING FACILITIES

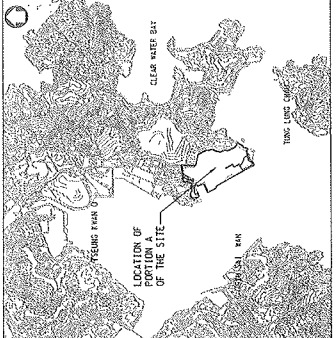

847000E
 846000E
 845000E

847000E
 846000E
 845000E

847000E
 846000E
 845000E



Appendix I

K


Monitoring Schedule for the Coming Month

Contract No. CV/2013/06 Handling of Surplus Public Fill
Tseung Kwan O Area137

Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hr TSP & 24-hr TSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitoring (NM)

June 2016

Sun	Mon	Tue	Wed	Thu	Fri	Sat
29	30 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (11:30-13:30) Mid-ebb (17:30-19:30)	31	1 / 6 <u>1-hr TSP</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-ebb (08:00 -10:00) Mid-flood (14:00 -16:00)	2 <u>24 hr TSP</u>	3 <u>1-hr TSP x 2</u> <u>WQM</u> Mid-ebb (10:00 -12:00) Mid-flood (16:00 -18:00)	4
5	6 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:00-09:30) Mid-ebb (12:00-14:00)	7	8 <u>1-hr & 24 hr TSP</u> <u>NM</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (14:00-16:00)	9	10 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:30-10:30) Mid-ebb (15:00-17:00)	11
12	13 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (11:30-13:30) Mid-ebb (18:00-20:00)	14 <u>24 hr TSP</u>	15 <u>1-hr TSP x 2</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-ebb (08:30 -10:30) Mid-flood (14:30 -16:30)	16	17 <u>1-hr TSP</u> <u>WQM</u> Mid-ebb (09:30 -11:30) Mid-flood (16:30 -18:30)	18
19	20 <u>1-hr & 24 hr TSP</u> <u>WQM</u> Mid-ebb (11:00 -13:00) Mid-flood (18:00 -20:00)	21	22 <u>1-hr TSP</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-flood (08:00-09:30) Mid-ebb (12:30-14:30)	23	24 <u>1-hr TSP</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (13:30-15:30)	25 <u>24 hr TSP</u>
26	27 <u>1-hr TSP x 2</u> <u>WQM</u> Mid-flood (09:45-11:45) Mid-ebb (16:15-18:15)	28	29 <u>1-hr TSP</u> <u>Weekly SI (am)</u> <u>WQM</u> Mid-ebb (08:00 -10:00) Mid-flood (12:45 -14:45)	30 <u>24 hr TSP</u>	1 / 7	2



Appendix I

L

Complaint Log

Complaint Logs

Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
001	Siu Sai Wan Promenade	13 October 2014	One complaint was received via the Hotline on 13 October 2014 from a district councillor of Eastern District Council (Ref No.: H22/RS/00025513-14) against the dust emission from South East New Territories Landfill or Tsueng Kwan O 137 Fill Bank observed from a resident during the way at Siu Sai Wan Promenade in early October 2014. The complainant complained that the dust emission caused an environmental nuisance.	<p>After received the details of the complaint from the Contractor on 11 November 2014, ET have performed a site inspection on 11 November 2014 to investigate this event. During the site inspection, no fugitive dust emission was recorded within the working areas of the Fill Bank.</p> <p>Besides, refer to the dust monitoring data and ET weekly site inspections during the early October 2014, no evidence showed that fugitive dust emission was observed. Hence no further action was required.</p> <p>Due to this event, the Contractor was reminded to take more effort on the frequency of watering on site especially during dry weather.</p>	Closed
002B	佛堂洲 near TKO137 Fill Bank	20, 21 and 29 May 2016	Three complaints received on 20, 21 and 29 May 2016, which were forwarded to ET on 01 June 2016, from EPD (NCF-N08/RE/000012222-16, NCF-N08/RE/000012941-16 and NCF-N08/RE/000012543-16) against the muddy water discharged from TKO137 Fill Bank to the nearby marine area. The complainant complained that muddy water generated caused an environmental nuisance.	<p>After received the details of the complaint from the Contractor on 01 June 2016, ET have performed a site investigation on 01 June 2016 to investigate this event. During the site inspection, no muddy water was observed discharged from the Fill Bank to nearby environment.</p> <p>Besides, refer to the marine water monitoring results during that period, no exceedance was recorded on Turbidity and Suspended Solids. This reflects that this occurrence did not affect the condition of marine water near the TKO137 Fill Bank</p> <p>Details of Action(s) Taken by the Contractor:</p> <ul style="list-style-type: none"> • Drainage system were adequate and well maintained to prevent flooding and overflow; • Sand and silt removal facilities, e.g. sifting screen, were provided before the discharge point; • Temporary intercepting drains were used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers were used to assist the diversion of polluted stormwater to the intercepting channels; • Catchpits and intercepting channels were maintained, and the deposited silt and grit were removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times. 	Closed

Complaint Logs


Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
003B	Barging Points at TKO137 Fill Bank	25 and 27 May 2016	Two complaints received on 25 and 27 May 2016, which were forwarded to ET on 01 June 2016, from EPD (Ref. NCF-N08/RE/000012768-16 and NCF-N08/RE/000013040-16) against the dust emission from barging points at TKO137 Fill Bank. The complainant complained that dust generated caused an environmental nuisance.	<p>After received the details of the complaint from the Contractor on 01 June 2016, ET have performed a site investigation on 01 June 2016 to investigate this event. During the site inspection, no dust emission was observed at the Barging Handling Area.</p> <p>Besides, refer to the impact dust monitoring results on 25 and 27 May 2016, no exceedance was recorded.</p> <p>Details of Action(s) Taken by the Contactor:</p> <ul style="list-style-type: none"> • Proper operation of water spraying system at tipping hall • Repair and maintain the water spraying system at tipping hall properly • Provide high pressure jetting at the tipping end of the tipping hall • Provide water spraying system at the weighbridge to wet the debris and rubbles on the truck in order to reduce the dust emission during the unloading work 	Closed
004	Wan Po Road near Tseung Kwan O Industrial Estate	22 and 26 May 2016	Two complaints received on 22 and 26 May 2016, which were forwarded to ET on 02 June 2016, from 1823 (Case#2-2257302039) & EPD (Ref: NCF-N08/RE/000012545-16) and EPF (Ref. NCF-N08/RE/000013106-16) against the muddy water noted at Wan Po Road near Tseung Kwan O Industrial Estate. The complainant complained that water and waste generated caused an environmental nuisance.	<p>Refer to the ET site investigation on 03 June 2016, the condition of Wan Po Road near Tseung Kwan O Industrial Estate was found satisfactory.</p> <p>Details of Action(s) Taken by the Contactor:</p> <ul style="list-style-type: none"> • Regular water spraying by water lorries is provided for road cleaning at Wan Po Road; • Regular cleaning on Wan Po Road and the access road at the site exit by road sweeper to remove mud and gravel is arranged four times on each working day; • Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving; • Site vehicle for transporting materials are covered properly by using clean tarpaulin sheets; • Regular cleaning at the site haul road is provided to minimize the fugitive dust emission. 	Closed



Appendix I

M

Complaint Investigation Reports in this Reporting Month

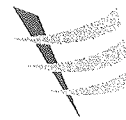


ETS-Testconsult Ltd – Environmental Team (ET)

Complaint Investigation Report

CEDD Contract No.: CV/2013/06
Handling of Surplus Public Fill (2014-2016)
Tseung Kwan O 137 Fill Bank



Details of the Complaint			Log No. : 002B
Date	20, 21 and 29 May 2016	Time	---
Location			
佛堂洲 near TKO137 Fill Bank			
Circumstances:			
Three complaints received on 20, 21 and 29 May 2016, which were forwarded to ET on 01 June 2016, from EPD (NCF-N08/RE/000012222-16, NCF-N08/RE/000012941-16 and NCF-N08/RE/000012543-16) against the muddy water discharged from TKO137 Fill Bank to the nearby marine area. The complainant complained that muddy water generated caused an environmental nuisance.			
Follow action(s)			
Follow up by	ET	Date	01 June 2016
Details of Follow up action(s)			
After received the details of the complaint from the Contractor on 01 June 2016, ET have performed a site investigation on 01 June 2016 to investigate this event. During the site inspection, no muddy water was observed discharged from the Fill Bank to nearby environment. (Attachment A)			
Due to this event, the Contractor replied that the muddy water observed from 20 to 29 May 2016 was due to insufficient desilting facilities to handle such large amount of surface runoff during the rainy period. The Contractor will enhance the existing desilting facilities, e.g. addition of desilting screens before the discharge point, at early June 2016.			
Besides, refer to the marine water monitoring results during that period, no exceedance was recorded on Turbidity and Suspended Solids (Attachment B). This reflects that this occurrence did not affect the condition of marine water near the TKO137Fill Bank.			
Details of Action(s) Taken by the Contactor			
<ol style="list-style-type: none"> 1. Drainage system were adequate and well maintained to prevent flooding and overflow; 2. Sand and silt removal facilities, e.g. silting screen, were provided before the discharge point; 3. Temporary intercepting drains were used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers were used to assist the diversion of polluted stormwater to the intercepting channels; 4. Catchpits and intercepting channels were maintained, and the deposited silt and grit were removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times; 			
Marine Water Quality Monitoring Data Review			
No impact marine water quality monitoring result of Turbidity and Suspended Solids was exceeded Action and Limit Level at all monitoring stations from 01 to 31 May 2016. (Attachment B)			
Conclusion			
Refer to the ET site investigation and marine water quality monitoring results, the overall marine water quality was considered to be acceptable during this period. The Contractor has implemented control measures to prevent impact to the environment but some improvement should be carried out.			
Due to this event, the Contractor was reminded to take more effort on sand and silt removal facilities especially during rain season.			
Prepared by:	Linda Law	Signature:	
Designation:	Senior Environmental Officer	Date:	09 August 2016
Checked by:	C. L. Lau	Signature:	
Designation:	Environmental Team Leader	Date:	09 August 2016





Attachment A

Photos during ET site investigation at TKO137 on 01 June 2016

佛堂洲

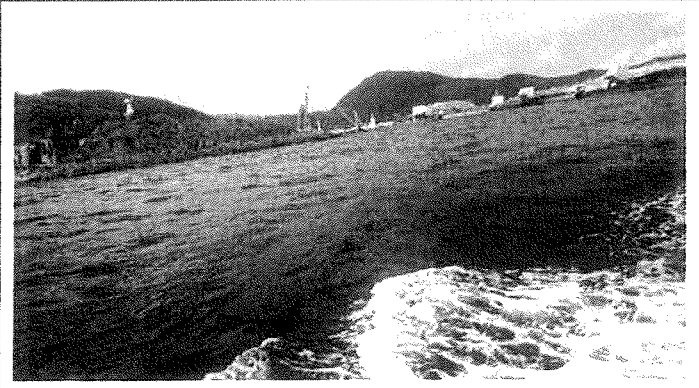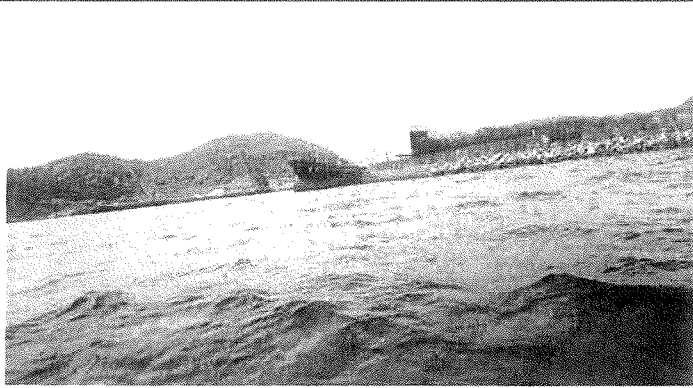


Barging Point at TKO137

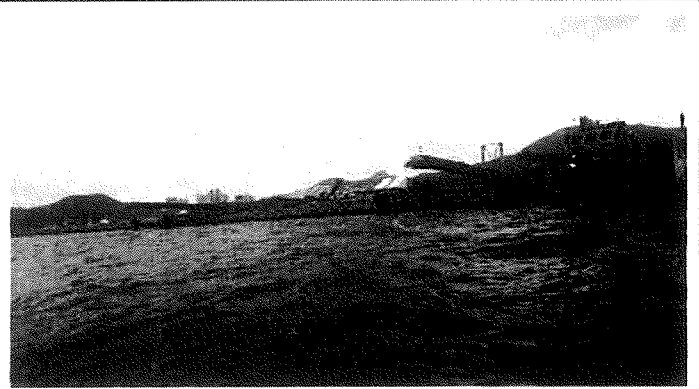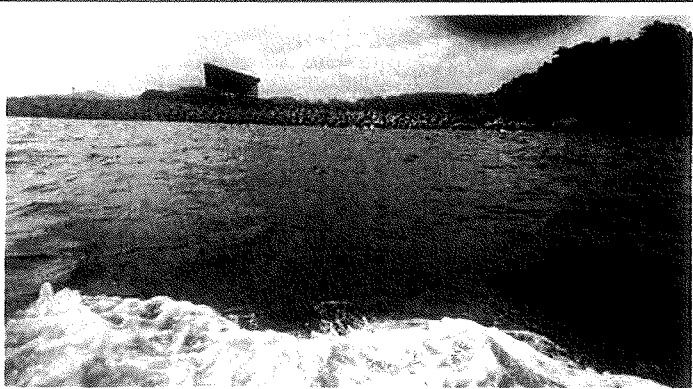







Suspended solids (Depth-average) at Mid-Flood Tide

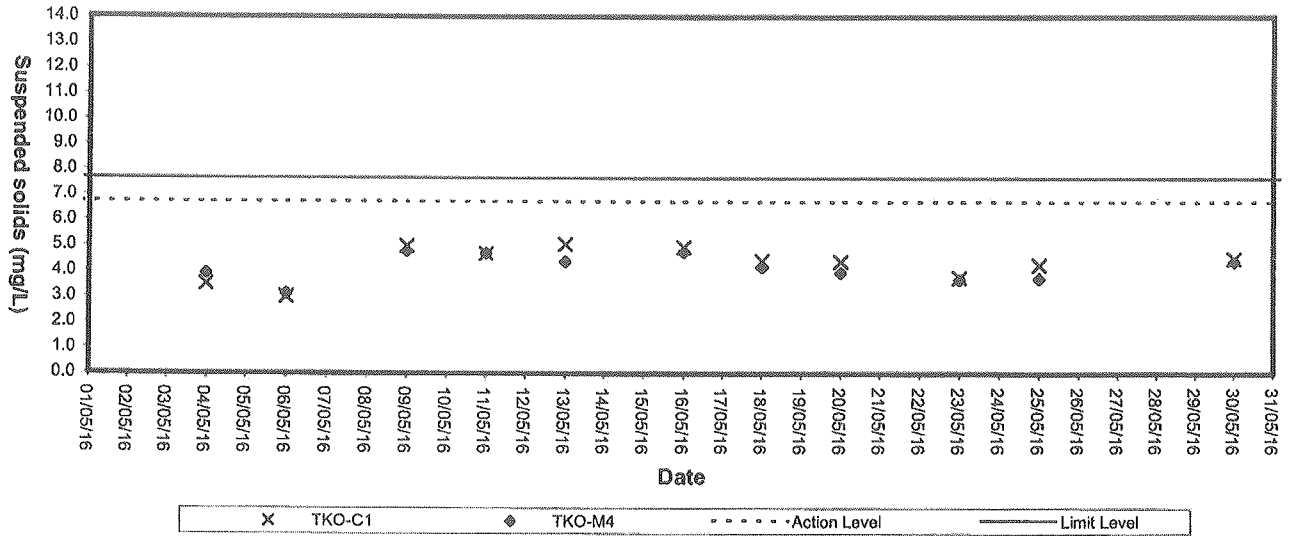

Suspended Solids (Depth-average) at Mid-Ebb Tide

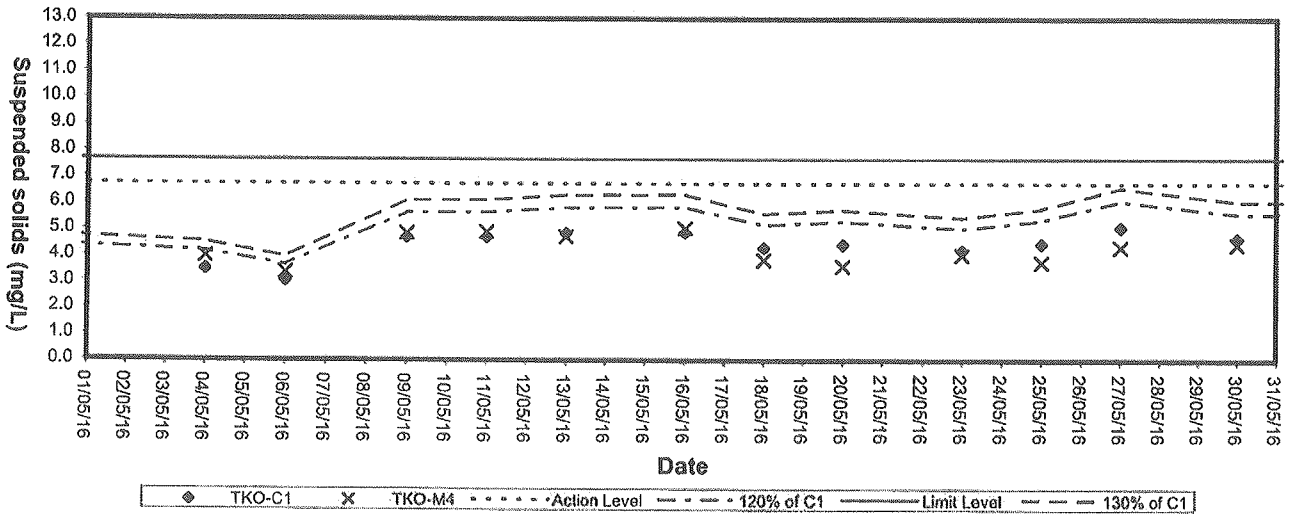

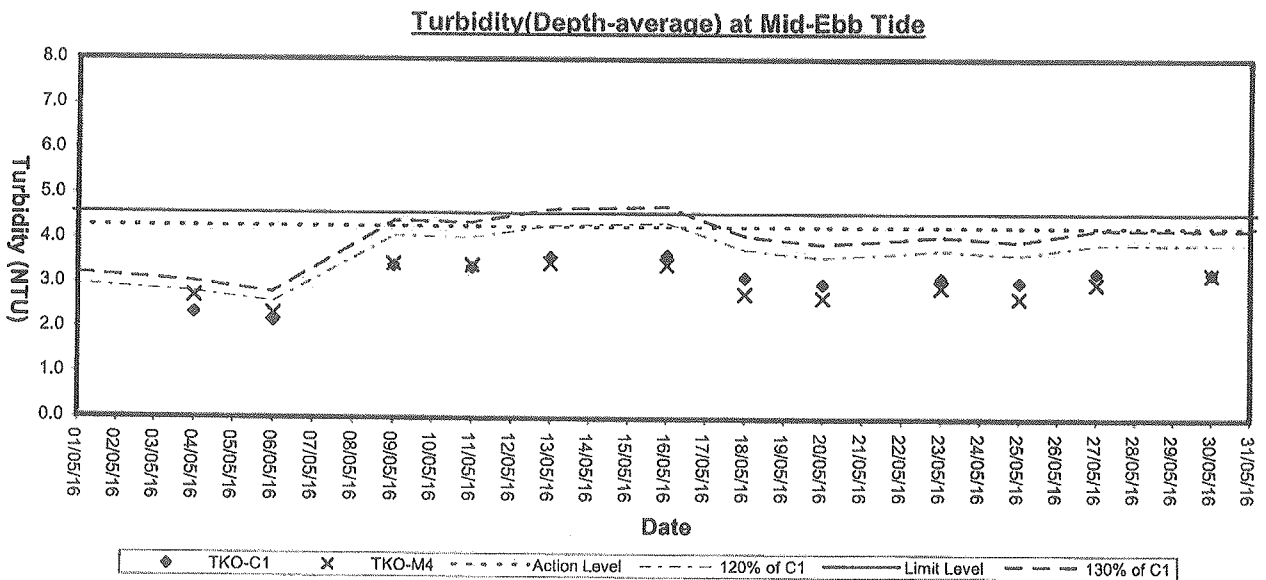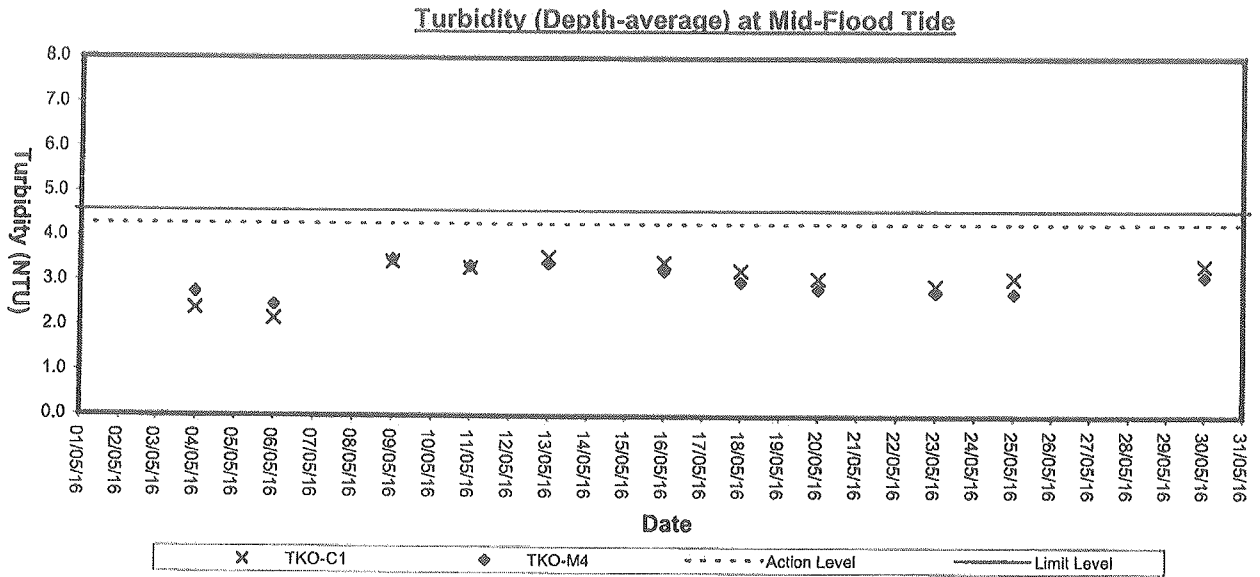

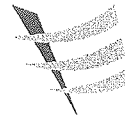

ETS-Testconsult Ltd – Environmental Team (ET)

Complaint Investigation Report

CEDD Contract No.: CV/2013/06
Handling of Surplus Public Fill (2014-2016)
Tseung Kwan O 137 Fill Bank

Details of the Complaint

Log No. : 003B

Date

25 and 27 May 2016

Time

Location

Barging Points at TKO137 Fill Bank

Circumstances:

Two complaints received on 25 and 27 May 2016, which were forwarded to ET on 01 June 2016, from EPD (Ref. NCF-N08/RE/000012768-16 and NCF-N08/RE/000013040-16) against the dust emission from barging points at TKO137 Fill Bank. The complainant complained that dust generated caused an environmental nuisance.

Follow action(s)

Follow up by

ET

Date

01 June 2016

Details of Follow up action(s)

After received the details of the complaint from the Contractor on 01 June 2016, ET have performed a site investigation on 01 June 2016 to investigate this event. During the site inspection, no dust emission was observed at the Barging Handling Area. (Attachment A)

Besides, refer to the impact dust monitoring results on 25 and 27 May 2016, no exceedance was recorded (Attachment B).

Details of Action(s) Taken by the Contactor

1. Proper operation of water spraying system at tipping hall
2. Repair and maintain the water spraying system at tipping hall properly
3. Provide high pressure jetting at the tipping end of the tipping hall
4. Provide water spraying system at the weighbridge to wet the debris and rubbles on the truck in order to reduce the dust emission during the unloading work

Marine Water Quality Monitoring Data Review

No impact dust monitoring result was exceeded Action and Limit Level at all monitoring stations on 25 and 27 May 2016. (Attachment B)

Conclusion

Refer to the ET site investigation and impact dust monitoring results, the overall air quality was considered to be acceptable during this period. The Contractor has implemented control measures to reduce impact to the environment.

Due to this event, the Contractor was still reminded to take more effort on dust suppression especially during dry season.

Prepared by:

Linda Law

Signature:

Designation:

Senior Environmental Officer

Date:

09 August 2016

Checked by:

C. L. Lau


Signature:

Designation:

Environmental Team Leader


Date:


09 August 2016



Attachment A

Photos during ET site investigation at TKO137 on 01 June 2016

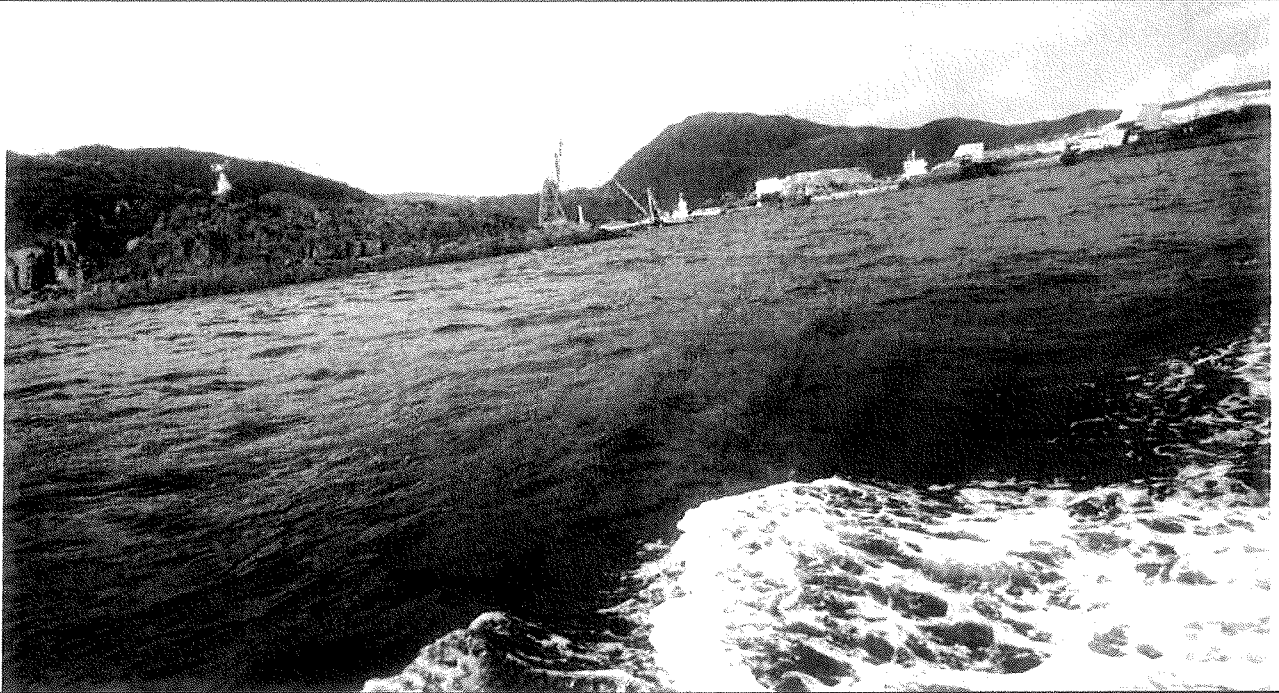



Attachment B

Impact 1-hr TSP results at TKO-A1 (Site Egress)

Date	1-hrTSP (mg/m ³)	Action Level (376µg/m ³ Exceedance	Limit Level (500µg/m ³ Exceedance
25/05/2016	180	No	No
27/05/2016	200	No	No

Impact 1-hr TSP results at TKO-A2a (CREO)

Date	1-hrTSP (mg/m ³)	Action Level (376µg/m ³ Exceedance	Limit Level (500µg/m ³ Exceedance
25/05/2016	203	No	No
27/05/2016	228	No	No



Impact 24-hr TSP results at TKO-A1 (Site Egress)

Date	1-hrTSP (mg/m ³)	Action Level (210µg/m ³ Exceedance	Limit Level (260µg/m ³ Exceedance
27/05/2016 to 28/05/2016	72	No	No

Impact 1-hr TSP results at TKO-A2a (CREO)







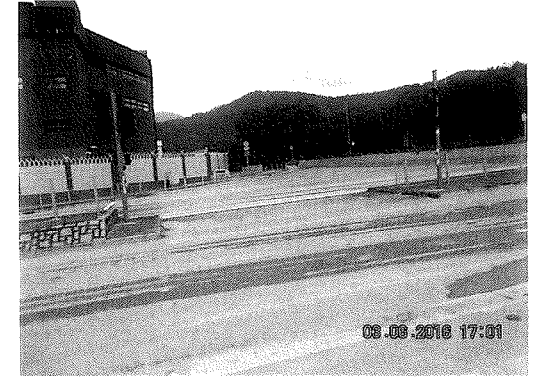

Date	1-hrTSP (mg/m ³)	Action Level (210µg/m ³ Exceedance	Limit Level (260µg/m ³ Exceedance
27/05/2016 to 28/05/2016	77	No	No



ETS-Testconsult Ltd – Environmental Team (ET)			
Complaint Investigation Report			
CEDD Contract No.: CV/2013/06 Handling of Surplus Public Fill (2014-2016) Tseung Kwan O 137 Fill Bank			
Details of the Complaint			Log No. : 004
Date	22 and 26 May 2016	Time	---
Location			
Wan Po Road near Tseung Kwan O Industrial Estate			
Circumstances:			
Two complaints received on 22 and 26 May 2016, which were forwarded to ET on 02 June 2016, from 1823 (Case#2-2257302039) & EPD (Ref: NCF-N08/RE/00012545-16) and EPF (Ref. NCF-N08/RE/00013106-16) against the muddy water noted Wan Po Road near Tseung Kwan O Industrial Estate. The complainant complained that water and waste generated caused an environmental nuisance.			
Follow action(s)			
Follow up by	ET	Date	03 June 2016
Details of Follow up action(s)			
Refer to the ET site investigation on 03 June 2016, the condition of Wan Po Road near Tseung Kwan O Industrial Estate was found satisfactory. (Attachment A). However, the Contractor was still reminded to increase the road cleaning frequency and improve the cleaning efficiency of the road sweeper. The Contractor replied that additional mitigation measures to cleanup the mud/debris adhered on the wheels of site truck will be implemented and additional road sweeper and water spraying will be arranged if necessary.			
Details of Action(s) Taken by the Contactor			
<ol style="list-style-type: none">1. Regular water spraying by water lorries is provided for road cleaning at Wan Po Road;2. Regular cleaning on Wan Po Road and the access road at the site exit by road sweeper to remove mud and gravel is arranged four times on each working day;3. Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;4. Site vehicle for transporting materials are covered properly by using clean tarpaulin sheets;5. Regular cleaning at the site haul road is provided to minimize the fugitive dust emission.			
Conclusion			
Due to the complaint, the Contractor has implemented control measures to reduce waste impact to the environment but some improvement should be carried out. The Contractor will take more effort on cleaning of site haul road and public road, and also site truck before leaving the site.			
Prepared by:	Linda Law	Signature:	
Designation:	Senior Environmental Officer	Date:	04 June 2016
Checked by:	C. L. Lau	Signature:	
Designation:	Environmental Team Leader	Date:	04 June 2016




Attachment A

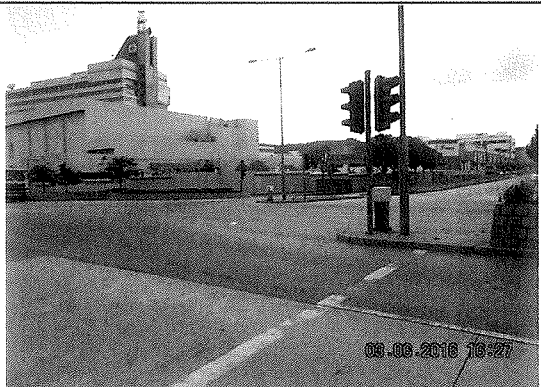Photos during ET site investigation at TKO137 on 03 June 2016	
Wheel washing facilities	
	
Site Entrance	
	
Wan Po Road near TVB	
	
	




Appendix I

Figures

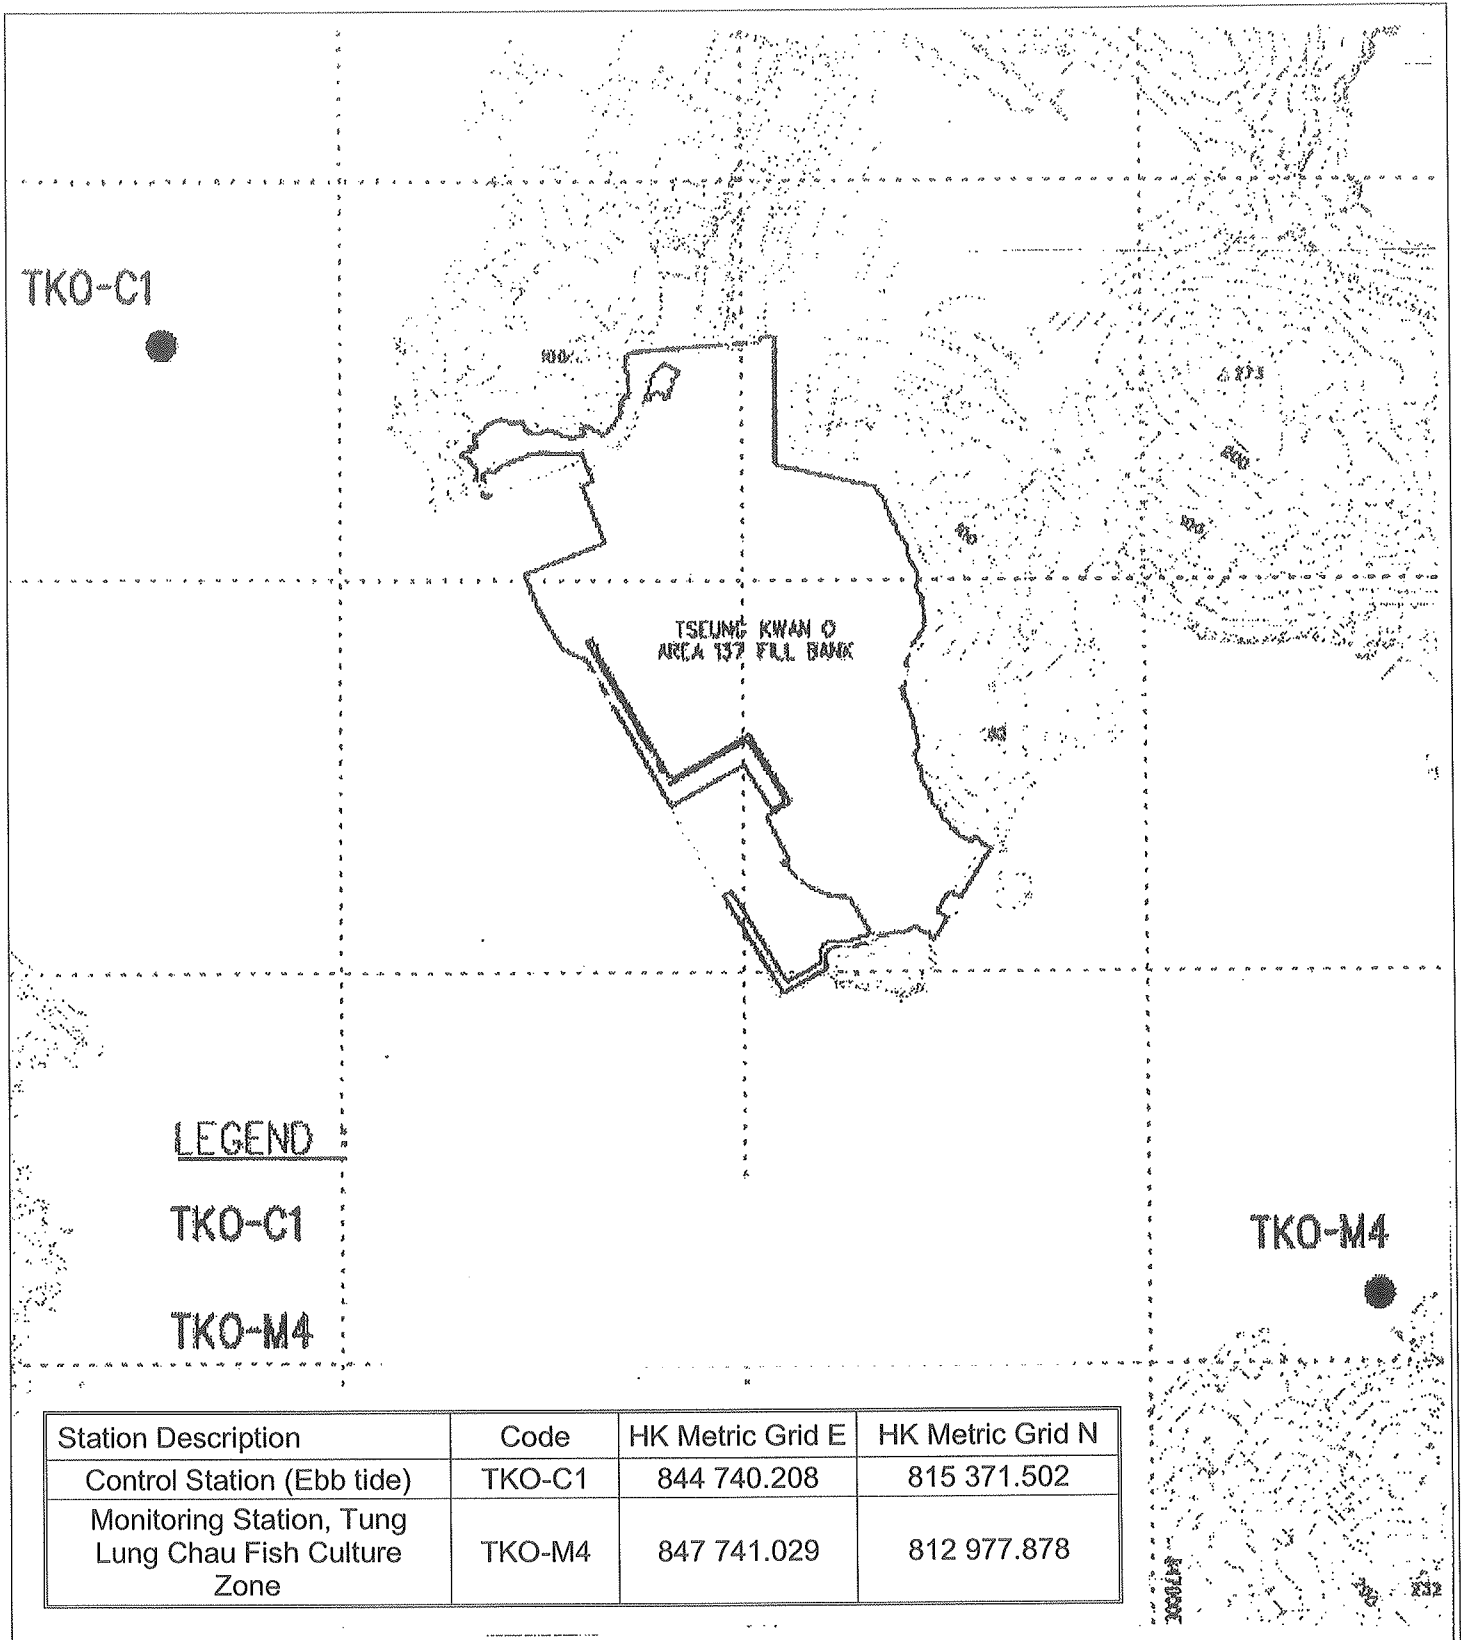

Contract No. CV/2013/06
 Handling of Surplus Public Fill (2014-2016)

Figure 1
 Locations of Water Quality Monitoring Stations –
 Tseung Kwan O Area 137 Fill Bank

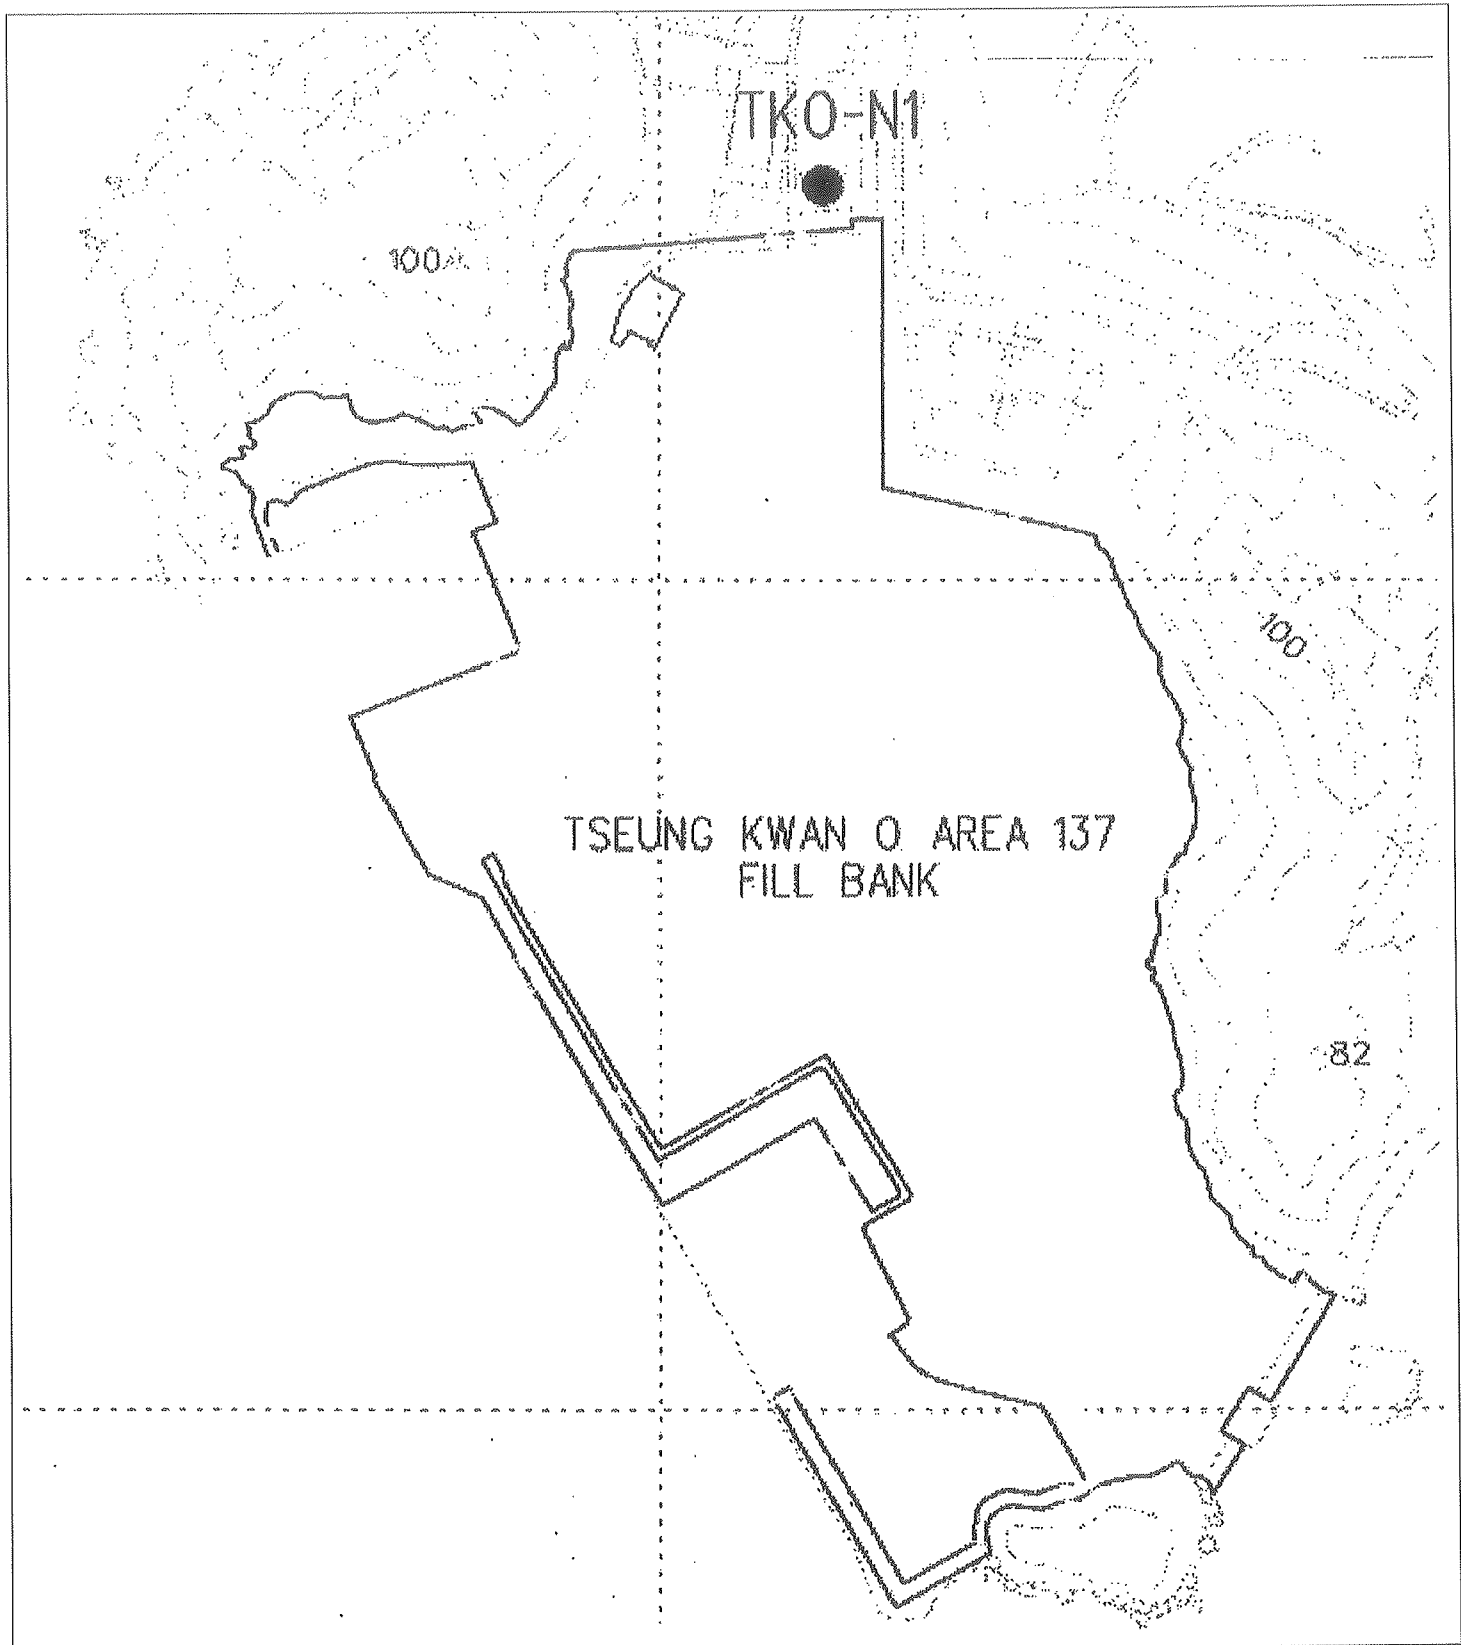


Contract No. CV/2013/06
Handling of Surplus Public Fill (2014-2016)

Figure 2
Location of Noise Monitoring Station –
Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

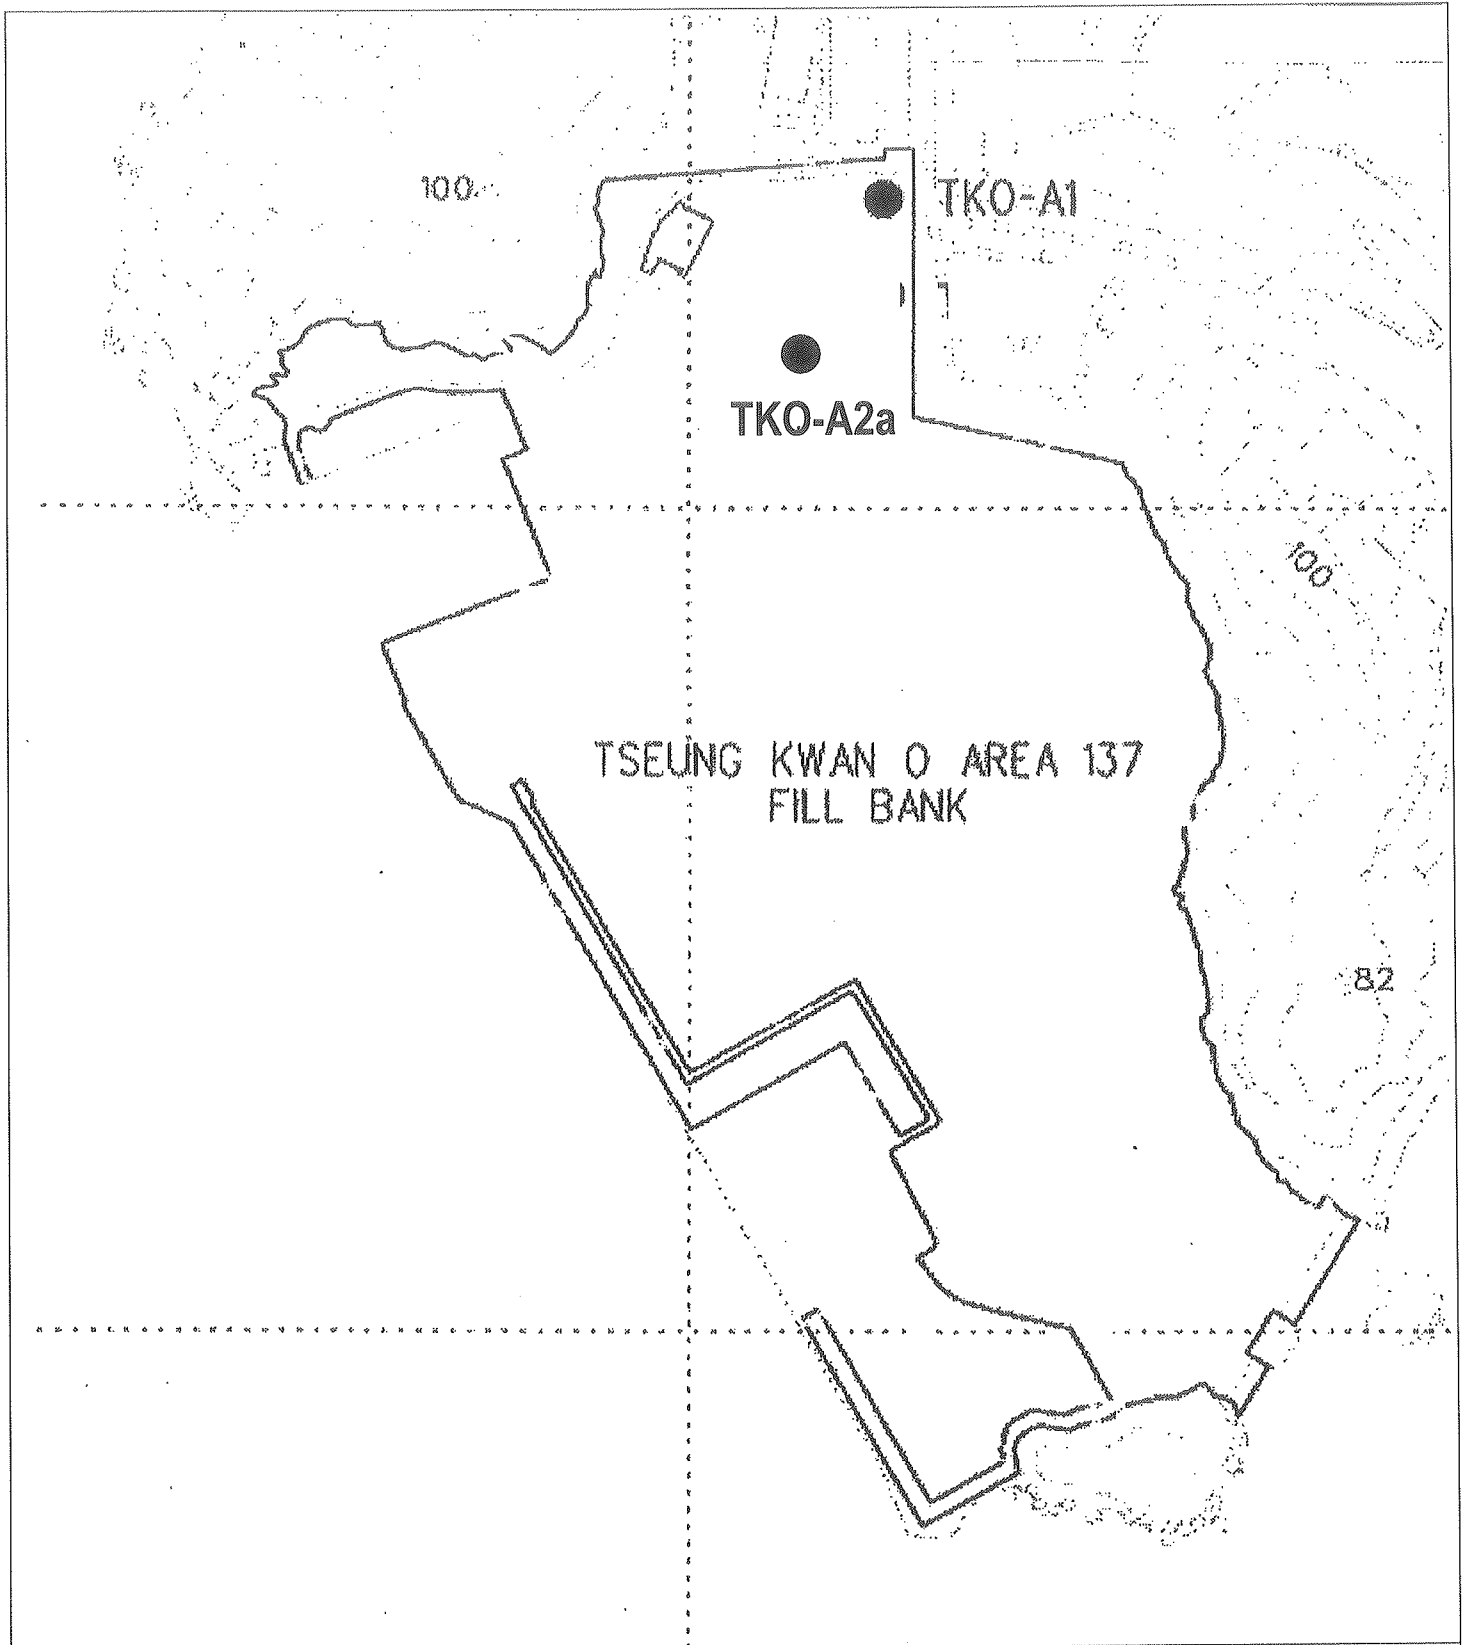

Contract No. CV/2013/06
Handling of Surplus Public Fill (2014-2016)

Figure 3
Locations of Air Quality Monitoring Stations –
Tseung Kwan O Area 137 Fill Bank



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED



Appendix II

**Marine Water Quality Monitoring Report for Contract No. HY/2010/02
Hong Kong – Zhuhai – Macao Bridge, Hong Kong Boundary Crossing
Facilities – Reclamation Works**



China Harbour Engineering Company Limited

Contract No. HY/2010/02

**Hong Kong – Zhuhai – Macao Bridge
Hong Kong Boundary Crossing
Facilities –
Reclamation Works**

**Impact Water Quality Monitoring Report
for TKO 137 Fill Bank
May 2016**

[06/2016]

	Name	Signature
Prepared & Checked:	Adam Zhu	
Reviewed & Approved:	Y T Tang	

Version:	Rev. 0	Date: 10 June 2016
<p>Disclaimer</p> <p>This report is prepared for China Harbour Engineering Company Limited and is given for its sole benefit in relation to and pursuant to Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities-Reclamation Works and may not be disclosed to, quoted to or relied upon by any person other than China Harbour Engineering Company Limited without our prior written consent. No person (other than China Harbour Engineering Company Limited) into whose possession a copy of this report comes may rely on this report without our express written consent and China Harbour Engineering Company Limited may not rely on it for any purpose other than as described above.</p>		

AECOM Asia Co. Ltd.
15/F, Grand Central Plaza, Tower 1, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong
Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com

TABLE OF CONTENTS

	Page
EXECUTIVE SUMMARY	i
1 INTRODUCTION	1
1.1 Background	1
1.2 Purpose of the Report	1
1.3 Structure of the Report	1
2 WATER QUALITY	2
2.1 Monitoring Requirements	2
2.2 Monitoring Equipment	2
2.3 Monitoring Parameters, Frequency and Duration	2
2.4 Monitoring Locations	2
2.5 Monitoring Methodology	3
2.6 Action and Limit Levels	4
3 MONITORING RESULTS	5
4 CONCLUSIONS	6

List of Tables

Table 2.1	Water Quality Monitoring Equipment.....	2
Table 2.2	Water Quality Monitoring Parameters, Frequency and Duration	2
Table 2.3	Location of Water Quality Impact Stations	3
Table 2.4	Action and Limit Levels for Water Quality	4
Table 2.5	Summary of Marine Water Monitoring Results for Mid-ebb Tide	5
Table 2.6	Summary of Marine Water Monitoring Results for Mid-flood Tide	5
Table 2.7	Summary of Marine Water Monitoring Exceedance.....	5

List of Figures

Figure 1.1	Site Layout Plan for TKO 137 Fill Bank
Figure 2.1	Impact Water Quality Monitoring Stations at TKO 137 Fill Bank

List of Appendices

Appendix A	Calibration Records
Appendix B	Impact Monitoring Schedules
Appendix C	Impact Water Quality Monitoring Results and their Graphical Presentation
Appendix D	QA/QC Report

EXECUTIVE SUMMARY

On-site sorting facilities for imported material (public fill) for reclamation works of the “Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below known as “the Works Area). Impact monitoring of water quality was conducted at the designated monitoring location. This report presents the impact monitoring results regarding water quality aspects performed in May 2016.

According to the Contractor information, the transportation and operation of the mentioned facility was suspended on 16 November 2015.

Water Quality

Impact water quality monitoring was conducted at three monitoring stations, C1a, M4a & M5. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations. The impact monitoring was carried out three times per week (from 1 to 31 May 2016) during the operation of the mentioned facilities for both mid-ebb and mid-flood tides. Data of temperature, salinity, dissolved oxygen (DO), turbidity (Tby) and suspended solids (SS) were collected and analysed. Details of the monitoring methodology, locations and results are presented in this report.

Breaches of Action and Limit Levels for Water Quality

No exceedance of Action and Limit Level of water quality monitoring results related to the Project was recorded in the reporting month.

1 INTRODUCTION

1.1 Background

- 1.1.1 Contract No. HY/2010/02 – Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Reclamation Work (here below, known as “the Project”) mainly comprises reclamation at the northeast of the Hong Kong International Airport of an area of about 130-hectare for the construction of an artificial island for the development of the Hong Kong Boundary Crossing Facilities (HKBCF), and about 19-hectare for the southern landfall of the Tuen Mun - Chek Lap Kok Link (TMCLKL).
- 1.1.2 On-site sorting facilities for imported material (public fill) for reclamation works of the Project were proposed to establish in Tseung Kwan O (TKO) 137 Fill Bank area (here below, known as “the Works Area”). The proposed sorting facilities together with barging points, tipping halls and associated facilities will be installed at the Works Area.
- 1.1.3 The latest Environmental Permit (EP) for Fill Bank at TKO Area 137 was issued on 4 February 2013 (EP-134/2002/K) by the Environmental Protection Department (EPD) to Civil Engineering and Development Department (CEDD), the Permit Holder, regarding the Project. Condition 3.2 of the EP requires the water quality monitoring frequency and parameters at stations C1a, M4a and M5 shall be same as the requirements set out in the EM&A Manual for TKO 137 Fill Bank (here below, known as “EM&A Manual”) and the monitoring results shall be incorporated in the monthly EM&A reports.
- 1.1.4 According to the Contractor information, the transportation and operation of the mentioned facility was suspended on 16 November 2015.

1.2 Purpose of the Report

- 1.2.1 The purpose of this impact monitoring report is to assess environmental impact and compliance during transportation and operation of the mentioned facilities for the Project. This report presents the impact monitoring requirements, methodologies and results of water quality measurements in accordance with the EM&A Manual.
- 1.2.2 This impact report presents the monitoring works of water quality monitoring, at two monitoring stations (M4a and M5) and one control station (C1a), conducted in May 2016. A layout plan of the Works Area is provided in Figure 1.1.

1.3 Structure of the Report

- 1.3.1 The structure of the report is as follows:

Section 1: Introduction, background, purpose and the structure of the report.

Section 2: Water quality, which describes the impact water quality monitoring requirements, methodology and action/limit level.

Section 3: Impact water quality monitoring results.

Section 4: Conclusions.

2 WATER QUALITY

2.1 Monitoring Requirements

2.1.1 Impact marine water quality monitoring at 3 water quality monitoring stations should be established. In accordance with the EM&A Manual, impact water quality monitoring should be conducted 3 days per week during the operation of the facilities in the Works Area. Moreover, as stipulated in the latest EP, water quality monitoring should be conducted since 2 weeks before commencement of operation of the additional barging points. Measurements shall be taken at the 3 designated stations, 2 impact and 1 control stations at mid-flood and mid-ebb tides at three water depths, i.e., 1 m below surface, mid-depth and 1 m from seabed.

2.2 Monitoring Equipment

2.2.1 Equipment used in the impact water quality monitoring programme is summarized in Table 2.1. A copy of the calibration certificates for the water quality monitoring equipment are attached in Appendix A.

Table 2.1 Water Quality Monitoring Equipment

Parameter	Model and Make
Coordinate of Monitoring stations	Garmin etrex 10
Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI Pro2030
Turbidity	HACH Model 2100Q Turbid Meter
Water Depth	Speedtech Instrument SM-5A

2.3 Monitoring Parameters, Frequency and Duration

2.3.1 Table 2.2 summarises the monitoring parameters, frequency and duration of impact water quality monitoring. Impact water quality monitoring was carried out at three stations in May 2016. Detailed impact water quality monitoring schedule was provided in Appendix B.

Table 2.2 Water Quality Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter, unit	Frequency	No. of Depths
<p><i>Control Stations:</i> C1a</p> <p><i>Impact Stations:</i> M4a – M5</p>	<ul style="list-style-type: none"> • Depth, m • Temperature, °C • Salinity, ppt • DO, mg/L • DO Saturation, % • Turbidity, NTU • Suspended Solids (SS), mg/L 	<p>Three times per week during mid-ebb and mid-flood tides (within ± 1.75 hour of the predicted time)</p>	<p>3 (1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth is less than 6 m, in which case the mid-depth station may be omitted. Should the water depth be less than 3 m, only the mid-depth station will be monitored).</p>

2.4 Monitoring Locations

2.4.1 The measurements were taken at all designated impact and control stations summarized in Table 2.3. The two impact stations were chosen on the basis of their proximity to the Works Area, which would be under the greatest potential for water quality impacts. In addition, a control station was also set up for ebb-tide references respectively of the surrounding ambient.

Table 2.3 Location of Water Quality Impact Stations

Station I.D.	HK 1980 Grid		Status
	Easting	Northing	
C1a	845647	814146	Control Station (Ebb-tide)
M4a	845922	813973	Impact Station (Close to Additional Barging Point, Tipping Halls and Associated Facilities at TKO 137 Fill Bank)
M5	847005	813678	Impact Station (Close to Tai Miu Wan)

2.5 Monitoring Methodology

2.5.1 Instrumentation

- (a) The in-situ water quality parameters, viz. dissolved oxygen, temperature, salinity and turbidity were measured by multi-parameter meters and turbidity was measured by Turbid Meter.

2.5.2 Operating/Analytical Procedures

- (a) A hand-held digital Global Positioning Systems (GPS) were used to ensure that the correct location was selected prior to sample collection.
- (b) Portable, battery-operated echo sounders were used for the determination of water depth at each designated monitoring station.
- (c) All in-situ measurements were taken at 3 water depths, 1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth was less than 6 m, in which case the mid-depth station was omitted. Should the water depth be less than 3 m, only the mid-depth station was monitored.
- (d) At each measurement/sampling depth, two consecutive in-situ monitoring (DO concentration and saturation, temperature, turbidity, salinity) and water sample for SS were collected. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO concentration and saturation, temperature and salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. Where the difference in the value between the first and second readings of DO or turbidity parameters was more than 25% of the value of the first reading, the reading was discarded and further readings were taken.
- (e) Duplicate samples from each independent sampling event were collected for SS measurement. Water samples were collected using the water samplers and the samples were stored in high-density polythene bottles. Water samples collected were well-mixed in the water sampler prior to pre-rinsing and transferring to sample bottles. Sample bottles were pre-rinsed with the same water samples. The sample bottles were then be packed in cool-boxes (cooled at 4°C without being frozen), and delivered to Environmental Laboratory, ETS-Testconsult Ltd. (HOKLAS Registration No. 022) for the analysis of suspended solids concentrations. The laboratory determination work would be started within 24 hours after collection of the water samples. Environmental Laboratory, ETS-Testconsult Ltd., is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes. For QA/QC procedures, one duplicate samples of every batch of 20 samples was analyzed and attached in Appendix D.

2.5.3 Maintenance and Calibration

- (a) Before each round of monitoring, the dissolved oxygen probe of YSI Pro2030 was calibrated by the wet bulb method.
- (b) The monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS before use and subsequently re-calibrated at 3-monthly intervals throughout all stages of the water quality monitoring.

2.6 Action and Limit Levels

2.6.1 The Action and Limit Levels (AL levels) have been set in accordance with the derivation criteria specified in the EM&A Manual. This is shown in Table 2.4.

Table 2.4 Action and Limit Levels for Water Quality

Parameters	Action	Limit
DO in mg/L (Surface & Middle, Bottom)	Surface & Middle 5.5 mg/L Bottom 5.2 mg/L	Surface & Middle 4.0 mg/L Bottom 2.0 mg/L
SS in mg/L (depth-averaged)	4.9 mg/L or 120% of upstream control station's SS at the same tide of the same day	5.2 mg/L or 130% of upstream control station's SS at the same tide of the same day and specific sensitive receiver water quality requirements (e.g. required suspended solids level at FCZ)
Turbidity in NTU (depth-averaged)	3.9 NTU or 120% of upstream control station's turbidity at the same tide of the same day	4.2 NTU or 130% of upstream control station's turbidity at the same tide of the same day

- Notes:
1. "depth-averaged" is calculated by taking the arithmetic means of reading of all three depths.
 2. For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
 3. For turbidity, SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.
 4. All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered as necessary.

3 MONITORING RESULTS

3.1.1 The impact water quality monitoring results for C1a, M4a and M5 are summarized in Tables 2.5 and 2.6. Detail water quality monitoring results are presented in Appendix C.

Table 2.5 Summary of Marine Water Monitoring Results for Mid-ebb Tide

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	24.7 (22.5 - 27.8)	29.2 (27.9 - 30.1)	7.0 (6.7 - 7.8)	7.0 (6.6 - 7.8)	98.4 (90.9 - 110.4)	3.2 (1.8 - 4.1)	4.1 (2.4 - 5.9)
M4a	24.8 (22.5 - 27.7)	29.2 (28.1 - 30)	6.9 (6.7 - 7.9)	7.0 (6.7 - 7.5)	98.1 (91.3 - 111.9)	3.0 (1.9 - 4)	4.0 (2.4 - 5.4)
M5	24.8 (22.5 - 27.8)	29.1 (27.9 - 29.9)	7.0 (6.7 - 7.8)	6.9 (6.7 - 7.4)	98.6 (93.4 - 111.1)	3.0 (1.9 - 4.2)	3.9 (2.2 - 5.8)

Table 2.6 Summary of Marine Water Monitoring Results for Mid-flood Tide

Monitoring Station	Temperature (°C)	Salinity (ppt)	DO (SM) (mg/L)	DO (Bottom) (mg/L)	DO Saturation (%)	Turbidity (NTU)	SS (mg/L)
C1a	24.6 (23.4 - 26.9)	29.1 (28 - 30)	7.1 (6.8 - 7.9)	7.1 (6.8 - 7.6)	99.7 (93.9 - 112.2)	3.1 (1.9 - 4)	3.9 (2.3 - 5.4)
M4a	24.6 (23.4 - 26.9)	29.0 (27.9 - 29.8)	7.0 (6.7 - 7.8)	7.0 (6.8 - 7.4)	98.7 (94.1 - 110.9)	3.0 (1.9 - 4)	3.7 (2.2 - 5.6)
M5	24.6 (23.4 - 26.9)	28.9 (28.1 - 29.7)	7.1 (6.7 - 7.9)	7.0 (6.8 - 7.5)	99.3 (94.7 - 112.6)	3.0 (1.8 - 4.2)	3.8 (2 - 5.9)

3.1.2 The weather conditions during the monitoring period were generally cloudy and occasionally fine. Sea conditions for the majority of monitoring days were generally calm and small wave. No major water pollution source, which might affect the result observed during the impact monitoring period.

3.1.3 Since the water depths at all the monitoring stations were generally higher than 6m, sampling was conducted at three water depths at each station.

3.1.4 The summary of impact water quality exceedance related to the Project is shown in Table 2.7.

Table 2.7 Summary of Marine Water Monitoring Exceedance

Monitoring Station	Exceedance Level	DO (SM)		DO(Bottom)		Turbidity		SS		Total	
		Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
M4a	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0
M5	Action	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0


Note: S: Surface; and
 M: Mid-depth.


3.1.5 No exceedance of Action and Limit Level of water quality monitoring results related to the Project was recorded in the reporting month.

4 CONCLUSIONS

- 4.1.1 This impact monitoring report presents impact monitoring results for water quality at designated locations C1a, M4a and M5 in accordance with the EM&A Manual. Monitoring Station C1a serves as the control station; Monitoring Station M4a and M5 are the impact stations.
- 4.1.2 All laboratory results satisfied the QA/QC requirements and all monitoring equipment is properly calibrated and with valid calibration certificates.
- 4.1.3 According to the Contractor information, the transportation and operation of the mentioned facility was suspended on 16 November 2015.
- 4.1.4 No exceedance of Action and Limit Level of water quality monitoring results related to the Project was recorded in the reporting month.

FIGURES

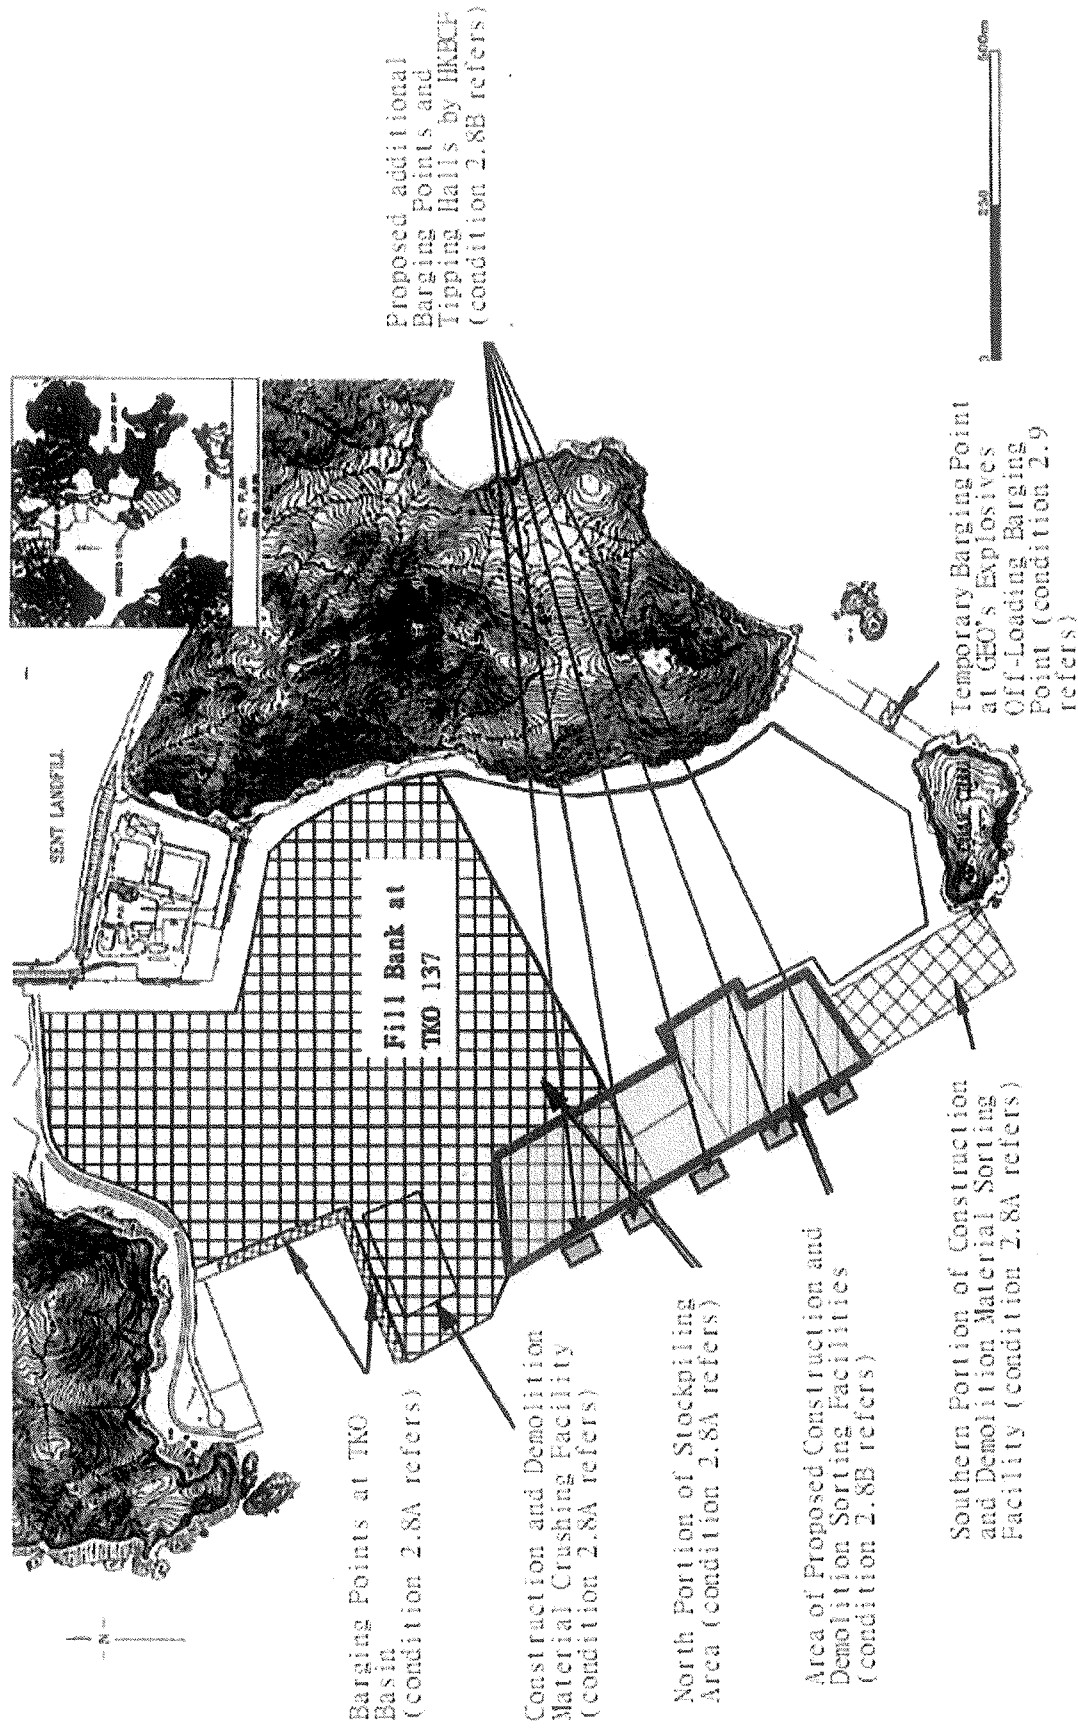

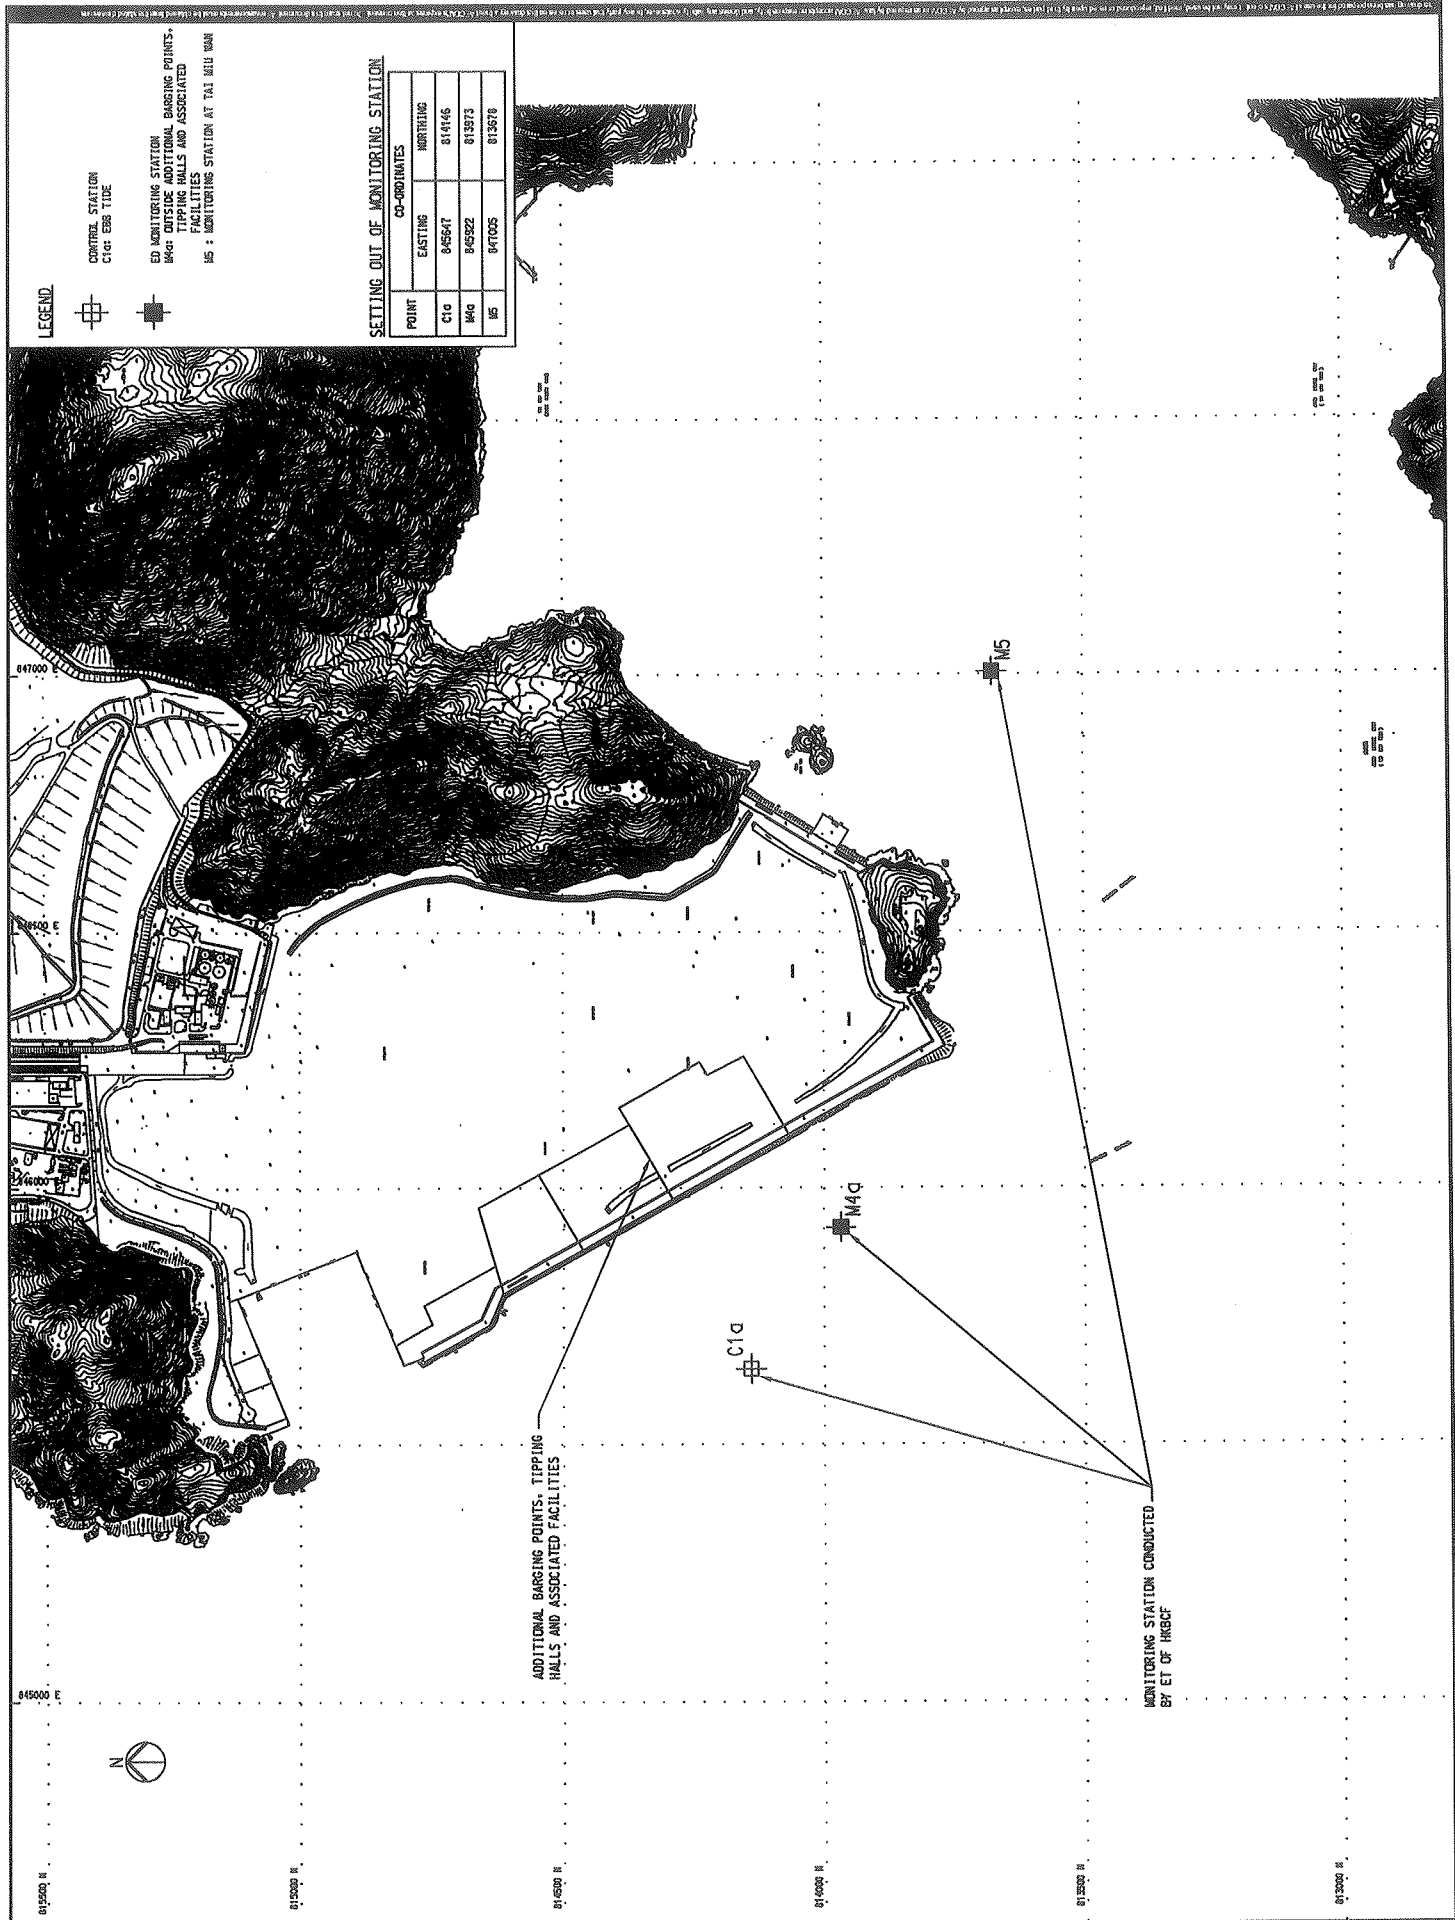

SETTING OUT OF MONITORING STATION

POINT	CO-ORDINATES	
	EASTING	NORTHING
C1a	845647	814446
M4Q	845822	813973
M5	847005	813676

LEGEND

CONTROL STATION
 C1a: EBB TIDE

ED MONITORING STATION
 M4Q: OUTSIDE ADDITIONAL BARGING POINTS,
 TIPPING HALLS AND ASSOCIATED
 FACILITIES

M5: MONITORING STATION AT TAI WU BAN

AECOM
 Figure 2

**APPENDIX A
CALIBRATION RECORDS**



Internal Calibration Report of Dissolved Oxygen Meter

Equipment Ref. No. : <u>ET/EW/008/001</u>	Manufacturer : <u>YSI</u>
Model No. : <u>85</u>	Serial No. : <u>05L 1285</u>
Date of Calibration : <u>26/04/2016</u>	Calibration Due Date : <u>25/07/2016</u>

Temperature Verification

Ref. No. of Reference Thermometer : ET/0521/017
 Ref. No. of Water Bath : ---

		Temperature (°C)		
Reference Thermometer reading	Measured	20.0	Corrected	19.9
DO Meter reading	Measured	20.0	Difference	-0.1

Standardization of sodium thiosulphate (Na₂S₂O₃) solution

Reagent No. of Na ₂ S ₂ O ₃ titrant	CPE/012/4.5/001/13	Reagent No. of 0.025N K ₂ Cr ₂ O ₇	CPE/012/4.4/002/09
		Trial 1	Trial 2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)		0.00	10.20
Final Vol. of Na ₂ S ₂ O ₃ (ml)		10.20	20.40
Vol. of Na ₂ S ₂ O ₃ used (ml)		10.20	10.20
Normality of Na ₂ S ₂ O ₃ solution (N)		0.02451	0.02451
Average Normality (N) of Na ₂ S ₂ O ₃ solution (N)		0.02451	
Acceptance criteria, Deviation		Less than ± 0.001N	

Calculation: Normality of Na₂S₂O₃, N = 0.25 / ml Na₂S₂O₃ used


Linearity Checking

Determination of dissolved oxygen content by Winkler Titration *

Purging Time (min)	2		5		10	
	1	2	1	2	1	2
Trial						
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	10.90	21.90	0.00	6.80	10.50
Final Vol. of Na ₂ S ₂ O ₃ (ml)	10.90	21.90	28.50	6.80	10.50	14.10
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	10.90	11.00	6.60	6.80	3.70	3.60
Dissolved Oxygen (DO), mg/L	7.17	7.24	4.34	4.47	2.43	2.37
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Purging time, min	DO meter reading, mg/L			Winkler Titration result *, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
2	7.33	7.42	7.38	7.17	7.24	7.21	2.33
5	4.20	4.26	4.23	4.34	4.47	4.41	4.17
10	2.30	2.34	2.32	2.43	2.37	2.40	3.39
Linear regression coefficient				0.9979			



Internal Calibration Report of Dissolved Oxygen Meter

Zero Point Checking

DO meter reading, mg/L	0.00
------------------------	------

Salinity Checking

Reagent No. of NaCl (10ppt)	CPE/012/4.7/003/14	Reagent No. of NaCl (30ppt)	CPE/012/4.8/003/14
-----------------------------	--------------------	-----------------------------	--------------------

Determination of dissolved oxygen content by Winkler Titration **

Salinity (ppt)	10		30	
	1	2	1	2
Initial Vol. of Na ₂ S ₂ O ₃ (ml)	0.00	11.40	22.80	32.50
Final Vol. of Na ₂ S ₂ O ₃ (ml)	11.40	22.80	32.50	42.10
Vol. (V) of Na ₂ S ₂ O ₃ used (ml)	11.40	11.40	9.70	9.60
Dissolved Oxygen (DO), mg/L	7.50	7.50	6.38	6.32
Acceptance criteria, Deviation	Less than + 0.3mg/L		Less than + 0.3mg/L	

Calculation: DO (mg/L) = V x N x 8000/298

Salinity (ppt)	DO meter reading, mg/L			Winkler Titration result**, mg/L			Difference (%) of DO Content
	1	2	Average	1	2	Average	
10	7.25	7.31	7.28	7.50	7.50	7.50	2.98
30	6.40	6.45	6.43	6.38	6.32	6.35	1.25

Acceptance Criteria

- (1) Differenc between temperature readings from temperature sensor of DO probe and reference thermometer : < 0.5 °C
- (2) Linear regression coefficient : >0.99
- (3) Zero checking: 0.0mg/L
- (4) Difference (%) of DO content from the meter reading and by winkler titration : within ± 5%

The equipment complies # / ~~does not comply~~ # with the specified requirements and is deemed acceptable # / unacceptable # for use.

Delete as appropriate

Calibrated by :

Approved by :



Performance Check of Salinity Meter

Equipment Ref. No. : ET/EW/008/001 Manufacturer : YSI
Model No. : 85 Serial No. : 05L 1285
Date of Calibration : 26/04/2016 Due Date : 25/07/2016

Ref. No. of Salinity Standard used (30ppt)

S/001/6

Salinity Standard (ppt)	Measured Salinity (ppt)	Difference * (%)
30.0	30.3	1.00

(*) Difference (%) = (Measured Salinity – Salinity Standard value) / Salinity Standard value x 100

Acceptance Criteria

Difference : -10 % to 10 %

The salinity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Checked by : 

Approved by : 



Performance Check of Turbidity Meter

Equipment Ref. No. : ET/0505/012 Manufacturer : HACH

Model No. : 2100Q Serial No. : 12060 C 018447

Date of Calibration : 29/03/2016 Due Date : 28/06/2016

Ref. No. of Turbidity Standard used (4000NTU)

005/6.1/001/9

Theoretical Value of Turbidity Standard (NTU)	Measured Value (NTU)	Difference % *
20	19.5	-2.50
100	98.2	-1.80
800	768	-4.00

(*) Difference = (Measured Value – Theoretical Value) / Theoretical Value x 100

Acceptance Criteria

Difference : -5 % to 5 %

The turbidity meter complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use. Measurements are traceable to national standards.

Prepared by : 

Checked by : 

**APPENDIX B
IMPACT MONITORING SCHEDULES**

**Contract No. HY/2010/02 - Hong Kong-Zhuhai-Macao Bridge
Hong Kong Boundary Crossing Facilities – Reclamation Works
Tentative Impact Water Quality Monitoring (WQM) Schedule for May 2016 (TKO 137 Fill Bank)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
01-May	02-May	03-May	04-May	05-May	06-May	07-May
			Impact WQM Mid-ebb: 10:28 Mid-flood: 16:24		Impact WQM Mid-ebb: 11:55 Mid-flood: 18:16	
08-May	09-May	10-May	11-May	12-May	13-May	14-May
	Impact WQM Mid-flood: 07:29 * Mid-ebb: 14:12		Impact WQM Mid-flood: 08:49 Mid-ebb: 15:55		Impact WQM Mid-flood: 10:27 Mid-ebb: 17:55	
15-May	16-May	17-May	18-May	19-May	20-May	21-May
	Impact WQM Mid-ebb: 09:17 Mid-flood: 14:56		Impact WQM Mid-ebb: 10:36 Mid-flood: 16:45		Impact WQM Mid-ebb: 11:35 Mid-flood: 18:10	
22-May	23-May	24-May	25-May	26-May	27-May	28-May
	Impact WQM Mid-ebb: 13:06 Mid-flood: 20:03		Impact WQM Mid-flood: 07:24 ** Mid-ebb: 14:18		Impact WQM Mid-flood: 09:36 Mid-ebb: 15:42	
29-May	30-May	31-May	01-Jun	02-Jun	03-Jun	04-Jun
	Impact WQM Mid-flood: 12:20 Mid-ebb: 18:55		Impact WQM Mid-ebb: 09:15 Mid-flood: 15:08		Impact WQM Mid-ebb: 10:51 Mid-flood: 17:16	

The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc)

(*) Proposed WQM on 09 May 2016 will be carried out between 08:00 to 10:00 because the site works start from 08:00. The proposed WQM period is within the flood tide (03:57 to 11:00 on 09 May 2016).

(**) Proposed WQM on 25 May 2016 will be carried out between 08:00 to 10:00 because the site works start from 08:00. The proposed WQM period is within the flood tide (04:06 to 10:41 on 25 May 2016).

**APPENDIX C
IMPACT WATER QUALITY MONITORING
RESULTS AND THEIR GRAPHICAL
PRESENTATION**

Mid-Ebb Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Value	Depth-average	Value
04/05/16	0953-1007	25/Cloudy	Calm	16.3	Surface	22.7	29.2	7.4	101.6	1.9	2.7	2.0	2.6	2.7		
					Middle	22.6	29.3	7.6	104.2	1.8	2.4					
					Bottom	22.6	29.1	7.7	104.9	1.9	2.7					
06/05/16	1125-1139	28/Cloudy	Calm	16.5	Surface	22.6	28.9	7.7	105.7	2.6	3.1	2.0	2.5	2.5		
					Middle	22.5	28.8	7.8	106.3	2.6	4.0					
					Bottom	23.3	29.2	7.0	98.9	2.0	2.4					
09/05/16	1318-1331	30/Cloudy	Calm	16.1	Surface	23.1	29.1	7.2	99.7	2.5	3.2	2.5	3.5	3.8		
					Middle	23.1	29.3	7.3	100.3	2.6	3.8					
					Bottom	23.0	29.1	7.3	100.1	2.4	3.1					
11/05/16	1524-1542	29/Cloudy	Small Wave	16.0	Surface	23.0	29.0	7.3	100.8	2.4	3.1	3.3	4.2	4.4		
					Middle	23.9	29.6	6.9	96.1	3.3	4.7					
					Bottom	23.8	29.5	6.9	96.5	3.4	4.1					
13/05/16	1622-1639	27/Cloudy	Small Wave	16.4	Surface	23.6	29.8	6.8	95.3	3.2	4.8	3.8	5.0	5.0		
					Middle	23.7	29.9	6.8	95.0	3.3	4.6					
					Bottom	23.5	29.7	6.7	94.2	4.0	4.8					
16/05/16	0830-0845	26/Fine	Small Wave	16.7	Surface	23.6	29.8	6.8	94.6	3.9	5.9	3.9	4.8	4.8		
					Middle	24.1	29.7	6.9	96.4	3.3	4.3					
					Bottom	24.1	29.8	6.9	96.8	3.4	4.0					
18/05/16	0955-1000	25/Cloudy	Calm	17.1	Surface	23.8	30.1	6.8	95.3	3.2	4.2	3.2	4.0	4.2		
					Middle	23.7	30.0	6.8	95.1	3.3	4.6					
					Bottom	23.7	29.8	6.7	93.8	4.0	4.4					
20/05/16	1055-1109	24/Cloudy	Calm	16.4	Surface	23.7	29.9	6.7	93.8	3.9	5.1	3.9	4.8	4.8		
					Middle	23.6	29.9	6.6	96.3	3.8	5.0					
					Bottom	23.9	29.2	6.9	95.9	3.8	4.5					
18/05/16	0955-1000	25/Cloudy	Calm	17.1	Surface	23.8	29.3	6.8	94.9	3.6	4.9	3.5	5.0	5.0		
					Middle	23.7	29.4	6.8	94.4	3.5	4.9					
					Bottom	23.7	29.4	6.8	94.4	3.5	4.9					
20/05/16	1055-1109	24/Cloudy	Calm	16.4	Surface	23.6	29.5	6.6	92.8	4.1	5.7	4.0	5.3	5.3		
					Middle	23.6	29.6	6.6	92.3	4.0	4.8					
					Bottom	26.1	27.9	7.2	103.3	3.6	4.3					
16/05/16	0830-0845	26/Fine	Small Wave	16.7	Surface	26.0	28.0	7.1	103.1	3.6	4.7	3.6	4.5	4.5		
					Middle	25.9	28.1	7.0	94.1	3.6	4.4					
					Bottom	25.8	28.2	7.1	94.3	3.7	5.1					
18/05/16	0955-1000	25/Cloudy	Calm	17.1	Surface	25.7	28.3	6.9	92.3	3.7	4.5	3.7	5.1	5.1		
					Middle	25.7	28.3	6.9	92.5	3.7	5.6					
					Bottom	25.6	28.4	6.9	92.5	3.7	5.6					
20/05/16	1055-1109	24/Cloudy	Calm	16.4	Surface	24.7	29.1	6.8	96.1	2.9	3.7	2.9	3.6	3.6		
					Middle	24.6	29.3	6.8	97.0	2.9	3.5					
					Bottom	24.6	29.2	6.9	98.3	3.3	4.2					
18/05/16	0955-1000	25/Cloudy	Calm	17.1	Surface	24.6	29.4	7.0	98.9	3.3	4.9	3.3	4.0	4.0		
					Middle	24.6	29.4	7.0	98.9	3.3	3.7					
					Bottom	24.5	29.2	7.0	99.7	3.7	4.9					
20/05/16	1055-1109	24/Cloudy	Calm	16.4	Surface	24.5	29.2	7.1	100.4	3.8	4.9	3.8	4.9	4.9		
					Middle	24.8	29.5	7.1	101.1	2.9	3.5					
					Bottom	24.8	29.7	7.0	100.3	3.0	4.2					
20/05/16	1055-1109	24/Cloudy	Calm	16.4	Surface	24.8	29.7	7.1	101.1	3.2	4.7	3.2	4.5	4.5		
					Middle	24.8	29.7	7.1	101.7	3.2	4.2					
					Bottom	24.7	29.8	7.1	101.7	3.2	3.7					
20/05/16	1055-1109	24/Cloudy	Calm	16.4	Surface	24.7	29.6	7.0	98.8	2.9	3.7	2.9	3.7	3.7		
					Middle	24.7	29.6	6.9	98.8	2.9	3.6					
					Bottom	24.7	29.5	6.9	98.8	3.0	3.6					

Mid-Ebb Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)	
					Surface	Bottom		Value	Ave.	Value	Average	Value	Average	Value	Depth-average
23/05/16	1222-1239	28/Cloudy	Calm	16.6	Surface	1.0	25.0	28.4	7.8	28.5	110.4	3.3	4.3	4.1	
							24.9	28.5	7.7	109.9	3.3	3.9			
							24.8	28.6	7.4	105.5	3.1	4.0			
25/05/16	1328-1342	28/Cloudy	Calm	16.5	Middle	8.3	24.8	28.6	7.4	28.6	105.1	3.2	4.1	4.4	
							24.8	28.8	7.3	103.4	3.7	4.8			
							24.7	28.8	7.2	102.7	3.7	5.2			
27/05/16	1534-1548	27/Cloudy	Calm	16.3	Surface	1.0	25.9	29.7	6.8	29.8	92.1	3.3	4.6	4.2	
							25.8	29.8	6.9	92.9	3.2	3.8			
							25.7	29.5	6.7	90.9	3.1	3.7			
30/05/16	1758-1813	31/Cloudy	Calm	16.6	Middle	8.3	25.7	29.4	6.8	29.5	91.6	3.0	3.6	3.7	
							25.7	29.2	6.9	92.5	2.7	4.0			
							25.6	29.2	6.9	93.4	2.7	3.3			
27/05/16	1534-1548	27/Cloudy	Calm	16.3	Surface	1.0	26.7	29.4	6.7	29.5	95.9	3.0	4.2	4.3	
							26.7	29.6	6.8	96.4	3.1	4.3			
							26.6	29.7	6.8	97.8	3.3	3.9			
27/05/16	1534-1548	27/Cloudy	Calm	16.3	Middle	8.2	26.6	29.8	6.9	29.8	98.2	3.3	4.0	4.0	
							26.6	29.8	6.9	98.5	3.3	4.0			
							26.6	29.5	6.8	97.1	3.6	5.0			
30/05/16	1758-1813	31/Cloudy	Calm	16.6	Bottom	15.3	26.6	29.4	6.8	29.5	97.4	3.6	4.3	4.7	
							26.6	29.4	6.8	97.6	3.6	4.3			
							27.8	28.9	6.8	99.4	2.8	3.9			
30/05/16	1758-1813	31/Cloudy	Calm	16.6	Surface	1.0	27.7	28.8	6.7	28.9	98.7	2.9	4.0	4.0	
							27.6	28.7	6.9	100.5	3.2	4.8			
							27.6	28.8	6.9	101.7	3.2	4.5			
30/05/16	1758-1813	31/Cloudy	Calm	16.6	Middle	8.3	27.6	28.8	6.9	28.8	101.1	3.2	4.8	4.7	
							27.6	28.8	6.9	101.7	3.2	4.5			
							27.6	29.0	7.1	103.4	3.0	3.6			
30/05/16	1758-1813	31/Cloudy	Calm	16.6	Bottom	15.6	27.5	29.2	7.0	29.1	102.2	3.0	4.4	4.0	
							27.5	29.2	7.0	102.2	3.0	4.4			

Mid-Flood Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)		Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average
04/05/16	1555-1609	28/Cloudy	Calm	16.6	Surface	1.0	24.0	28.7	28.8	7.3	7.4	100.3	1.9	2.6	2.9		
					Middle	8.3	23.8	29.1	7.5	7.5	101.2	2.0	2.5				
					Bottom	15.6	23.9	29.3	7.5	7.6	102.4	2.1	2.8				
06/05/16	1724-1738	29/Cloudy	Calm	16.7	Surface	1.0	23.8	29.0	29.0	7.6	7.6	103.1	2.2	3.0	3.1		
					Middle	8.4	23.8	28.9	7.6	7.6	103.9	2.7	3.2				
					Bottom	15.7	23.8	28.7	6.9	6.9	104.6	2.8	3.4				
09/05/16	0830-0842	29/Cloudy	Calm	16.3	Surface	1.0	23.8	29.5	29.4	6.9	7.0	94.8	1.9	2.6	2.6		
					Middle	8.2	23.7	29.3	7.0	7.0	95.8	1.9	2.3				
					Bottom	15.3	23.6	29.7	6.9	6.9	98.3	2.3	3.0				
11/05/16	0824-2842	29/Cloudy	Small Wave	16.4	Surface	1.0	23.6	29.8	29.8	7.1	7.2	99.0	2.4	2.8	4.2		
					Middle	8.2	23.6	29.2	7.2	7.2	99.4	2.8	3.4				
					Bottom	15.4	23.5	29.1	7.3	7.2	100.3	2.9	3.7				
13/05/16	0952-1008	25/Cloudy	Calm	16.7	Surface	1.0	23.8	29.7	29.7	6.9	6.9	97.3	3.2	4.1	4.6		
					Middle	8.4	23.8	30.0	6.9	6.9	97.7	3.3	4.6				
					Bottom	15.7	23.7	29.9	6.8	6.8	98.3	3.3	4.7				
16/05/16	1424-1442	26/Fine	Small Wave	16.9	Surface	1.0	23.6	29.8	29.8	6.8	6.8	96.3	3.1	3.8	4.4		
					Middle	8.5	23.7	29.2	7.0	7.0	96.5	3.2	4.1				
					Bottom	15.9	23.7	29.1	6.9	6.9	96.3	3.3	4.3				
18/05/16	1555-1609	26/Cloudy	Calm	17.3	Surface	1.0	23.5	29.5	29.5	6.8	6.8	95.0	3.9	4.5	4.4		
					Middle	8.7	23.4	29.5	6.8	6.8	95.4	4.0	4.5				
					Bottom	16.3	26.0	28.1	7.2	7.2	94.5	3.7	4.1				
20/05/16	1727-1740	24/Cloudy	Calm	16.7	Surface	1.0	24.8	28.7	28.8	6.8	6.9	97.2	2.7	3.6	4.1		
					Middle	8.4	24.8	28.8	6.9	6.9	97.8	2.8	3.6				
					Bottom	15.7	24.7	29.0	7.0	7.1	99.2	3.8	4.1				

Mid-Flood Tide

Monitoring Station : C1a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)	
							Value	Ave.	Value	Average	Value	Average	Value	Depth-average
23/05/16	1853-1910	30/Cloudy	Small Wave	16.9	Surface	25.0	28.6	7.9	112.2	3.1	4.3	3.1	4.1	
					Middle	25.1	28.5	7.8	111.4	3.2	3.8			
					Bottom	24.9	28.7	7.6	107.9	3.0	3.9			
25/05/16	0832-0847	28/Cloudy	Calm	16.6	Surface	24.9	28.8	7.6	108.5	3.0	3.3	3.0	3.6	
					Middle	24.8	28.9	7.4	105.2	3.5	4.5			
					Bottom	24.8	28.9	7.3	104.6	3.6	4.6			
27/05/16	---	---	---	---	Surface	25.9	29.2	7.0	100.4	3.2	4.1	3.1	3.9	
					Middle	25.9	29.3	7.0	101.0	3.1	3.7			
					Bottom	25.8	29.1	7.1	101.8	3.0	3.9			
30/05/16	1158-1212	30/Cloudy	Calm	16.7	Surface	25.9	29.3	7.0	100.9	3.0	3.6	3.0	3.8	
					Middle	25.8	29.4	6.9	99.3	2.8	3.3			
					Bottom	25.8	29.3	6.9	99.9	2.9	3.2			
30/05/16	---	---	---	---	Surface	---	---	---	---	---	---	---	---	
					Middle	---	---	---	---	---	---			
					Bottom	---	---	---	---	---	---			
30/05/16	---	---	---	---	Surface	26.9	29.0	7.0	101.9	2.9	4.4	3.0	4.2	
					Middle	26.8	29.2	7.0	102.7	3.0	3.9			
					Bottom	26.7	29.1	6.9	100.5	3.3	4.3			
30/05/16	---	---	---	---	Surface	26.7	28.9	6.9	101.1	3.4	3.7	3.3	4.0	
					Middle	26.6	28.8	7.0	102.2	2.7	3.6			
					Bottom	26.6	28.7	7.1	103.1	2.8	3.4			

Mid-Ebb Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
04/05/16	1011-1025	25/Cloudy	Calm	19.1	Surface	1.0	22.7	28.8	29.0	7.1	7.1	97.0	97.6	1.9	1.9	2.4	2.4	2.8
					Middle	9.6	22.6	29.3	29.2	7.1	7.1	97.8	97.2	2.2	2.2	2.6	2.8	
					Bottom	18.1	22.5	29.1	29.2	6.8	6.8	96.6	93.1	2.3	2.3	2.9	3.2	
06/05/16	1143-1157	28/Cloudy	Calm	19.1	Surface	1.0	23.3	28.7	28.8	6.9	6.9	95.4	95.7	2.4	2.4	2.6	2.8	3.1
					Middle	9.6	23.3	29.1	29.2	7.0	7.0	95.9	96.8	2.1	2.1	2.5	2.9	
					Bottom	18.1	23.2	29.3	29.1	7.1	7.2	97.2	99.6	2.2	2.5	3.3	3.6	
09/05/16	1338-1351	30/Cloudy	Calm	18.8	Surface	1.0	23.1	29.0	29.1	7.2	7.2	99.9	99.6	3.3	3.2	4.3	4.4	4.9
					Middle	9.4	23.9	29.3	29.2	6.7	6.7	94.0	93.8	3.4	3.4	4.8	4.9	
					Bottom	17.8	23.7	29.1	29.2	6.8	6.8	95.2	95.0	3.5	3.5	5.3	5.4	
11/05/16	1548-1606	29/Cloudy	Small Wave	18.9	Surface	1.0	23.5	29.6	29.7	6.9	6.9	97.0	96.8	3.8	3.8	4.9	4.8	4.3
					Middle	9.5	23.8	29.8	29.9	6.9	6.9	96.6	96.4	3.9	3.8	5.4	4.6	
					Bottom	17.9	24.1	29.4	29.4	6.7	6.7	94.0	93.9	3.2	3.2	4.2	4.2	
13/05/16	1645-1701	27/Cloudy	Small Wave	19.0	Surface	1.0	24.0	29.3	29.6	6.8	6.8	93.8	94.8	3.2	3.2	4.1	4.1	4.7
					Middle	9.5	23.9	29.5	29.6	6.8	6.8	95.0	94.8	3.4	3.4	4.0	4.1	
					Bottom	18.0	23.8	29.6	29.6	6.8	6.8	94.5	94.4	3.5	3.5	4.2	4.2	
16/05/16	0850-0905	28/Fine	Small Wave	19.1	Surface	1.0	23.7	29.8	29.9	6.9	6.9	96.7	96.4	3.7	3.7	4.9	4.8	4.7
					Middle	9.6	23.8	29.3	29.3	6.8	6.8	95.5	95.3	3.7	3.7	4.6	4.5	
					Bottom	18.1	23.8	29.3	29.3	6.8	6.8	95.1	95.3	3.7	3.7	4.8	4.5	
18/05/16	1004-1018	25/Cloudy	Calm	19.0	Surface	1.0	23.7	29.4	29.5	6.7	6.7	94.0	93.8	3.6	3.5	4.3	4.3	3.9
					Middle	9.5	25.5	28.5	28.6	6.9	6.9	93.5	94.4	3.5	3.9	5.2	4.2	
					Bottom	18.0	25.7	28.4	28.6	6.9	6.9	94.2	94.4	3.9	3.9	4.7	4.8	
20/05/16	1113-1128	24/Cloudy	Calm	19.1	Surface	1.0	23.5	29.6	29.7	6.8	6.8	94.6	102.4	4.0	4.0	4.8	4.8	3.7
					Middle	9.6	26.0	28.1	28.2	7.1	7.1	102.3	102.5	3.4	3.5	4.5	4.5	
					Bottom	18.1	25.9	28.2	28.4	7.0	6.9	92.7	92.8	3.6	3.6	4.5	4.5	

Mid-Ebb Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom		Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
23/05/16	1245-1301	28/Cloudy	Calm	18.7	Surface	1.0	25.0	28.4	7.9	111.9	111.7	3.5	4.9	3.4	4.9	4.5	3.4	4.8
							25.0	28.3	7.8	111.4	3.4	4.1						
							24.9	28.5	7.7	109.4	3.1	4.7	4.8					
25/05/16	1346-1400	28/Cloudy	Calm	19.0	Middle	9.5	24.8	28.6	7.7	108.8	109.1	3.2	3.1	2.5	3.1	3.4	3.4	3.4
							24.8	28.8	7.5	106.5	3.6	5.0						
							24.8	28.9	7.4	105.8	3.6	5.1						
27/05/16	1552-1607	27/Cloudy	Calm	19.0	Surface	1.0	25.8	29.1	6.9	99.9	99.4	2.1	2.5	2.8	2.5	3.3	2.9	3.7
							25.9	29.3	6.8	98.8	2.2	3.2						
							25.8	29.2	6.8	98.1	2.4	3.1	3.4					
30/05/16	1818-1832	31/Cloudy	Calm	19.0	Bottom	18.0	25.7	29.0	6.7	97.7	98.1	3.1	4.3	3.1	3.1	3.8	3.8	3.8
							25.7	28.9	6.8	98.4	3.1	3.4						
							26.8	29.9	6.7	95.4	2.8	3.4	3.3					
27/05/16	1552-1607	27/Cloudy	Calm	19.0	Middle	9.5	26.8	29.7	6.7	96.3	95.9	2.9	3.1	3.1	3.1	3.4	3.8	3.8
							26.7	29.6	6.9	98.2	3.1	4.3						
							26.7	29.5	6.8	97.5	3.2	4.1	4.2					
30/05/16	1818-1832	31/Cloudy	Calm	19.0	Bottom	18.0	26.6	29.7	6.9	98.8	99.2	3.3	3.7	2.6	3.7	3.5	3.8	3.8
							26.7	29.5	7.0	99.5	3.4	3.8						
							27.7	28.4	6.8	99.6	2.3	3.5	3.6					
30/05/16	1818-1832	31/Cloudy	Calm	19.0	Surface	1.0	27.7	28.3	6.7	98.6	99.1	2.4	3.6	2.4	3.6	3.5	3.8	3.8
							27.7	28.6	6.9	100.7	2.4	3.3						
							27.6	28.7	6.9	101.7	2.5	3.7	3.8					
30/05/16	1818-1832	31/Cloudy	Calm	19.0	Middle	9.5	27.6	28.8	7.0	102.8	102.4	2.9	3.7	2.9	3.7	3.5	3.8	3.8
							27.6	28.8	7.0	102.8	2.9	3.7						
							27.6	28.9	7.0	102.0	3.0	3.8	3.8					

Mid-Flood Tide

Monitoring Station : M4a

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Dissolved Oxygen		Turbidity (NTU)		Suspended Solids (mg/L)	
							Value	Ave.	Value	Average	Value	Average	Value	Average	Value	Average
23/05/16	1915-1932	30/Cloudy	Small Wave	19.1	Surface	25.1	28.6	28.6	7.8	110.9	110.6	3.3	4.3	3.3	4.2	4.2
						25.2	28.5	28.5	7.8	110.3	110.6	3.3	4.0			
					Middle	25.0	28.7	28.7	7.6	108.3	108.5	3.1	4.3	3.1	4.1	
						24.9	28.7	28.7	7.6	108.7	108.5	3.2	3.8			
					Bottom	24.8	28.8	28.9	7.4	105.0	105.3	3.4	4.8	3.4	4.4	
						24.7	28.9	28.9	7.4	105.6	105.3	3.4	4.0			
25/05/16	0851-0904	28/Cloudy	Calm	19.1	Surface	25.9	29.4	29.5	6.7	97.5	97.9	2.2	2.8	2.2	2.8	3.2
						26.0	29.5	29.5	6.8	98.2	98.2	2.2	2.7			
					Middle	25.8	29.3	29.3	6.8	99.1	99.6	2.5	3.3	2.5	3.1	
						25.8	29.2	29.3	6.9	100.1	99.6	2.4	2.9			
					Bottom	25.7	29.0	29.1	6.8	98.2	98.5	2.9	3.4	2.9	3.6	
						25.8	29.1	29.1	6.8	98.8	98.5	3.0	3.8			
27/05/16	---	---	---	---	Surface	---	---	---	---	---	---	---	---	---	---	
						---	---	---	---	---	---	---	---			
					Middle	---	---	---	---	---	---	---	---	---		---
						---	---	---	---	---	---	---	---			
					Bottom	---	---	---	---	---	---	---	---	---		---
						---	---	---	---	---	---	---	---			
30/05/16	1217-1231	30/Cloudy	Calm	19.2	Surface	26.9	28.7	28.7	6.8	99.8	100.2	2.2	2.4	2.2	2.7	3.1
						26.9	28.6	28.6	6.9	100.5	100.5	2.2	2.9			
					Middle	26.8	28.4	28.4	6.9	101.1	101.5	2.6	2.8	2.6	2.9	
						26.8	28.3	28.3	7.0	101.8	101.5	2.6	3.0			
					Bottom	26.8	28.4	28.3	6.8	99.2	99.7	3.0	3.6	3.0	3.9	
						26.7	28.2	28.3	6.8	100.1	99.7	3.0	4.1			

Mid-Ebb Tide

Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)		Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
					Surface	Bottom	Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
04/05/16	1029-1043	25/Cloudy	Calm	15.6	Surface	1.0	22.7	28.7	28.7	7.2	7.2	97.9	2.1	2.1	2.3	2.6	2.8		
					Middle	7.8	22.6	28.6	28.6	7.2	7.2	98.6	2.2	2.2	2.8	2.5			
					Bottom	14.6	22.5	28.8	28.9	7.1	7.1	96.7	1.9	1.9	2.6	3.3			
06/05/16	1201-1215	28/Cloudy	Calm	15.6	Surface	1.0	22.5	29.1	29.2	7.0	7.0	96.1	2.6	2.6	3.1	3.3	2.8		
					Middle	7.8	22.5	29.2	29.2	7.0	7.0	95.5	2.7	2.7	3.5	2.7			
					Bottom	14.6	23.2	29.4	29.3	7.2	7.2	98.6	1.9	1.9	2.6	2.7			
09/05/16	1357-1410	30/Cloudy	Calm	15.7	Surface	1.0	23.1	29.1	29.2	7.1	7.1	98.7	2.0	2.0	2.2	2.5	4.9		
					Middle	7.9	23.1	29.2	29.2	7.1	7.1	97.8	2.1	2.1	2.7	2.5			
					Bottom	14.7	23.0	29.0	29.0	7.4	7.4	101.8	2.5	2.5	3.5	3.2			
11/05/16	1612-1630	29/Cloudy	Small Wave	15.8	Surface	1.0	23.0	28.9	29.3	6.8	6.8	95.5	3.4	3.4	4.4	4.3	4.6		
					Middle	7.9	23.9	29.2	29.2	6.8	6.8	95.1	3.4	3.4	4.1	4.5			
					Bottom	14.8	23.7	29.1	29.2	6.7	6.7	94.0	3.9	3.9	5.1	5.2			
13/05/16	1708-1715	27/Cloudy	Small Wave	15.9	Surface	1.0	23.6	29.2	29.3	6.7	6.7	93.6	3.8	3.8	5.3	4.8	5.0		
					Middle	8.0	23.6	29.2	29.3	6.7	6.7	95.6	3.3	3.3	4.7	4.8			
					Bottom	14.9	23.7	29.4	29.5	6.8	6.8	94.3	3.9	3.9	4.9	5.4			
16/05/16	0910-0925	26/Fine	Small Wave	16.2	Surface	1.0	23.6	29.5	29.5	6.7	6.7	93.9	3.8	3.8	5.8	5.4	4.6		
					Middle	8.1	23.6	29.5	29.5	6.7	6.7	104.1	3.3	3.3	4.6	4.8			
					Bottom	15.2	26.2	27.9	28.0	7.2	7.2	104.3	3.3	3.3	4.9	4.8			
18/05/16	1023-1038	25/Cloudy	Calm	15.4	Surface	1.0	26.0	28.1	28.1	7.2	7.1	95.6	3.4	3.4	4.4	4.8	4.3		
					Middle	7.7	25.9	28.1	28.1	7.1	7.1	95.4	3.4	3.4	4.4	4.8			
					Bottom	14.4	25.7	28.2	28.3	7.0	7.0	93.4	3.4	3.4	3.8	4.2			
20/05/16	1145-1200	24/Cloudy	Calm	15.5	Surface	1.0	25.8	29.5	29.6	6.8	6.8	96.5	3.5	3.5	4.5	5.1	3.1		
					Middle	7.8	24.7	29.2	29.3	6.8	6.8	97.2	2.3	2.3	3.2	3.2			
					Bottom	14.5	24.6	29.7	29.7	7.0	7.0	98.7	3.7	3.7	4.9	5.1			

Mid-Ebb Tide

Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)		Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
						Value	Ave.	Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
23/05/16	1307-1324	28/Cloudy	Calm	15.9	Surface	25.0	28.4	7.8	7.8	111.1	111.0	3.2	3.2	3.9	4.0	4.2		
						24.9	28.5	7.8	7.8	110.9	3.2	4.1						
						24.9	28.6	7.6	7.5	107.5	3.1	3.4						
					24.9	28.7	7.5	7.5	107.0	3.1	3.7							
					24.8	28.8	7.4	7.4	105.1	3.4	4.8							
					24.8	28.8	7.4	7.4	104.7	3.5	5.2							
25/05/16	1405-1420	28/Cloudy	Calm	15.5	Surface	25.9	28.7	6.9	6.9	99.6	100.0	2.4	2.5	3.6	3.3	3.3		
						25.9	28.9	6.9	6.9	100.4	2.5	3.0						
						25.8	28.9	7.0	7.0	101.2	3.1	4.0						
					25.8	29.1	7.1	7.0	102.1	3.1	3.4							
					25.8	29.0	6.8	6.8	98.7	2.3	3.0							
					25.7	29.2	6.9	6.8	99.3	2.4	2.9							
27/05/16	1611-1625	27/Cloudy	Calm	15.4	Surface	26.9	29.7	7.0	6.9	99.4	99.2	2.6	2.6	2.9	3.1	3.7		
						26.8	29.5	6.9	6.9	98.9	2.5	3.3						
						26.8	29.6	6.8	6.9	97.6	3.4	4.1						
					26.8	29.5	6.9	6.9	98.4	3.5	4.1							
					26.8	29.3	6.8	6.8	96.8	3.2	3.5							
					26.7	29.4	6.8	6.8	97.3	3.2	4.2							
30/05/16	1836-1851	31/Cloudy	Calm	15.6	Surface	27.8	28.7	6.9	6.9	101.1	101.5	2.2	2.2	3.0	2.9	3.2		
						27.8	28.8	7.0	6.9	101.9	2.3	2.7						
						27.8	29.0	6.8	6.9	100.3	2.5	3.0						
					27.7	28.9	6.9	6.9	100.9	2.6	3.6							
					27.6	28.8	6.8	6.7	99.5	2.3	3.0							
					27.7	28.7	6.7	6.7	98.4	2.4	3.6							

Mid-Flood Tide

Monitoring Station : M5




Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)			Turbidity (NTU)			Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Depth-average	Value	Average	Depth-average	Value	Average	Depth-average
04/05/16	1631-1645	28/Cloudy	Calm	15.8	Surface	23.8	28.4	7.3	7.4	100.1	100.3	2.3	2.2	2.7	3.1		
					Middle	23.9	28.6	7.2	7.2	100.5	97.6	2.2	2.4	2.6			
					Bottom	23.8	28.2	7.1	7.0	98.1	97.1	2.3	2.4	3.0			
06/05/16	1800-1814	29/Cloudy	Calm	15.9	Surface	23.8	28.5	7.1	7.1	96.2	95.9	2.9	2.9	3.6	2.8		
					Middle	23.7	28.7	7.0	7.1	95.6	97.1	3.0	1.8	2.5			
					Bottom	23.6	29.0	7.2	7.3	97.9	99.5	1.8	2.2	2.0			
09/05/16	0906-0918	29/Cloudy	Calm	16.0	Surface	23.5	29.0	7.3	7.3	100.2	101.3	2.2	2.2	3.1	4.7		
					Middle	23.5	28.9	7.3	7.3	100.2	99.9	2.2	2.2	2.9			
					Bottom	23.5	29.2	7.3	7.4	100.8	101.8	2.6	2.6	3.4			
11/05/16	0912-1930	29/Cloudy	Small Wave	16.0	Surface	23.4	29.1	6.9	6.9	97.2	96.7	4.2	4.2	5.9	4.7		
					Middle	23.4	29.0	7.0	7.0	97.1	96.9	3.3	3.3	4.2			
					Bottom	23.4	29.4	6.8	6.8	97.6	97.4	3.2	3.2	4.0			
13/05/16	1037-1053	25/Cloudy	Calm	16.2	Surface	23.6	29.4	6.8	6.8	95.9	95.7	3.8	3.8	4.6	3.9		
					Middle	23.6	29.3	6.8	6.8	95.2	95.0	3.8	3.8	4.1			
					Bottom	23.6	29.4	6.8	6.9	94.7	96.9	3.7	3.2	3.6			
16/05/16	1512-1530	26/Fine	Small Wave	16.4	Surface	23.5	29.5	7.0	7.0	97.1	97.5	4.1	4.0	4.9	4.3		
					Middle	23.5	29.4	6.8	6.8	96.7	96.1	4.0	3.2	4.8			
					Bottom	23.7	29.1	7.0	7.0	97.3	97.3	3.3	3.4	4.0			
18/05/16	1632-1647	26/Cloudy	Calm	15.7	Surface	23.7	29.0	7.4	7.4	107.3	107.2	3.3	3.4	3.7	4.2		
					Middle	23.7	28.2	7.4	7.3	107.1	97.7	3.4	3.5	4.4			
					Bottom	23.6	28.3	7.3	7.3	97.6	97.7	3.5	3.5	4.2			
20/05/16	1804-1819	24/Cloudy	Calm	15.8	Surface	25.7	28.3	7.3	7.2	97.8	96.6	3.6	3.6	4.6	3.5		
					Middle	25.6	28.4	7.3	6.9	96.7	96.6	3.6	3.6	4.6			
					Bottom	25.5	28.5	7.2	6.8	96.5	95.0	3.6	3.6	4.0			
18/05/16	1632-1647	26/Cloudy	Calm	15.7	Surface	24.7	29.0	6.7	6.8	95.6	96.1	2.2	2.3	3.1	4.2		
					Middle	24.7	28.9	6.8	6.9	96.5	98.3	2.3	3.4	2.8			
					Bottom	24.6	28.8	6.9	6.9	97.8	98.3	3.4	3.4	4.1			
20/05/16	1804-1819	24/Cloudy	Calm	15.8	Surface	24.6	29.5	6.8	6.8	98.7	96.8	3.7	3.7	5.2	3.7		
					Middle	24.6	29.4	6.8	6.8	97.2	97.7	3.7	3.7	4.9			
					Bottom	24.5	29.0	6.9	6.9	98.1	97.7	3.7	3.7	5.1			
20/05/16	1804-1819	24/Cloudy	Calm	15.8	Surface	24.7	29.4	6.8	6.8	97.4	97.8	2.6	2.5	3.1	3.7		
					Middle	24.6	29.6	6.9	6.8	98.1	97.8	2.5	3.1	3.0			
					Bottom	24.5	29.5	6.8	6.8	96.3	96.8	3.1	3.1	4.0			
20/05/16	1804-1819	24/Cloudy	Calm	15.8	Surface	24.5	29.7	7.0	6.9	97.2	99.0	2.9	3.0	3.5	3.5		
					Middle	24.5	29.5	6.8	6.8	99.3	99.0	2.9	3.0	3.5			
					Bottom	24.5	29.6	6.9	6.9	98.6	99.0	3.0	3.0	3.9			

Mid-Flood Tide




Monitoring Station : M5

Date	Sampling Duration	Ambient Temp (°C) / Weather Condition	Sea Condition	Total Water Depth (m)	Monitoring Depth (m)	Water Temp (°C)	Salinity (ppt)		Dissolved Oxygen (mg/L)		Turbidity (NTU)		Suspended Solids (mg/L)		
							Value	Ave.	Value	Average	Value	Average	Value	Depth-average	Value
23/05/16	1939	30/Cloudy	Small Wave	16.2	Surface	25.1	28.6	7.9	112.0	3.0	4.2	3.0	4.0		
						25.1	28.6	7.9	112.6	3.0	3.8				
					Middle	25.0	28.8	7.7	109.9	2.8	3.1	2.9	3.2		
						25.0	28.7	7.7	109.2	2.9	3.2				
					Bottom	24.9	28.8	7.5	107.5	3.1	3.7	3.1	3.8		
						24.8	28.7	7.5	106.9	3.2	3.8				
25/05/16	0908-0923	28/Cloudy	Calm	15.7	Surface	26.0	29.2	7.0	101.0	2.6	3.3	2.6	3.3		
						26.0	29.4	7.0	102.1	2.7	3.2				
					Middle	25.9	29.3	6.9	99.3	2.9	3.8	2.9	3.7		
						25.8	29.1	6.9	100.3	3.0	3.5				
					Bottom	25.8	29.0	6.8	98.7	2.4	3.2	2.5	3.4		
						25.8	29.2	6.9	99.8	2.5	3.5				
27/05/16	---	---	---	---	Surface	---	---	---	---	---	---	---	---		
					Middle	---	---	---	---	---	---	---	---	---	---
					Bottom	---	---	---	---	---	---	---	---	---	---
					Surface	---	---	---	---	---	---	---	---	---	---
					Middle	---	---	---	---	---	---	---	---	---	---
					Bottom	---	---	---	---	---	---	---	---	---	---
30/05/16	1235-1250	30/Cloudy	Calm	15.8	Surface	26.9	28.3	6.7	98.6	2.3	3.0	2.3	3.2		
						26.8	28.5	6.8	99.3	2.4	3.3				
					Middle	26.8	28.4	6.9	100.6	2.6	3.1	2.7	3.2		
						26.7	28.2	7.0	101.7	2.7	3.2				
					Bottom	26.6	28.1	7.0	102.2	2.5	3.7	2.5	3.5		
						26.6	28.2	6.9	101.3	2.6	3.3				


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide

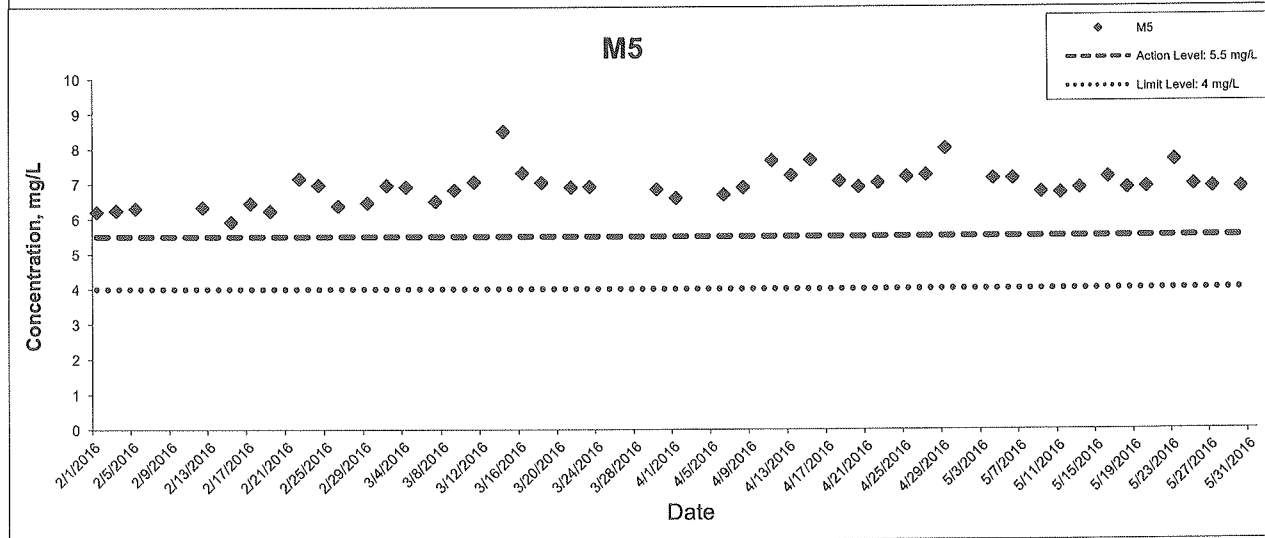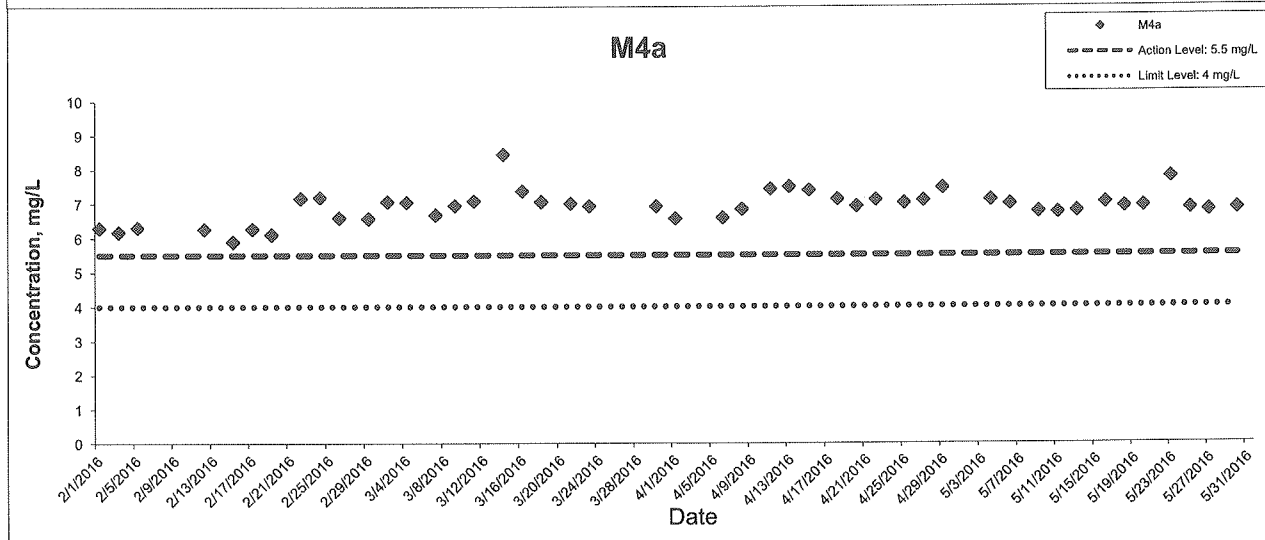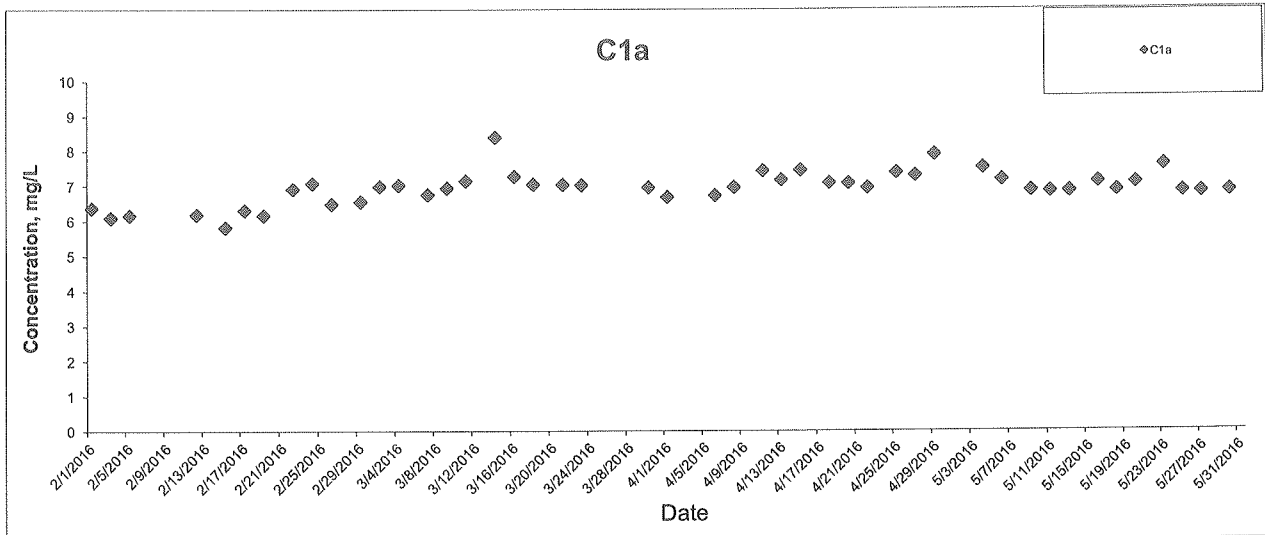




Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

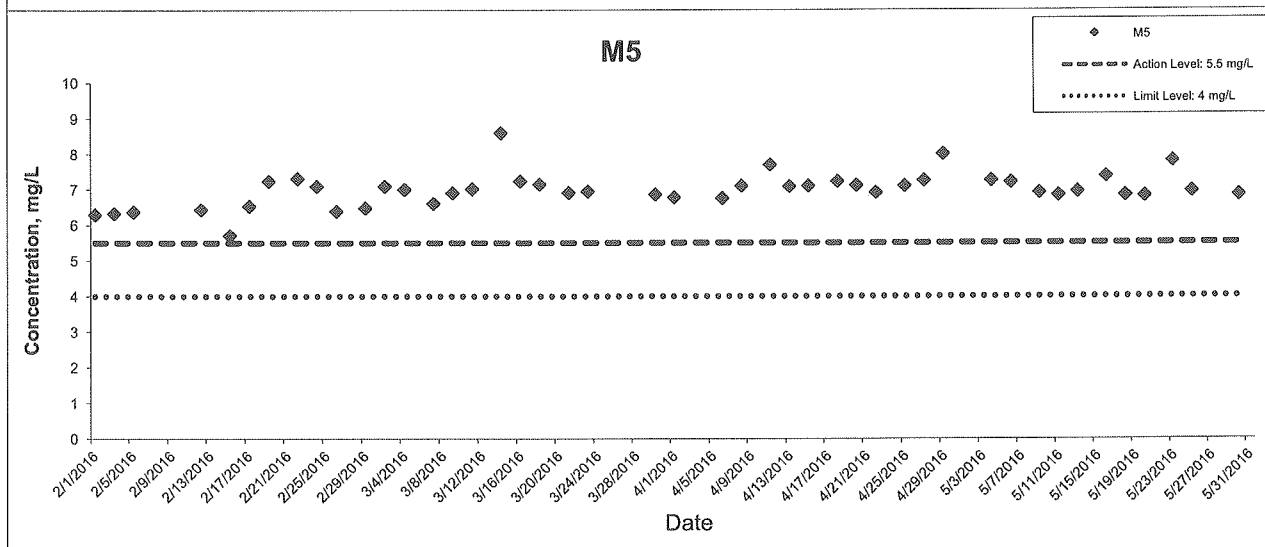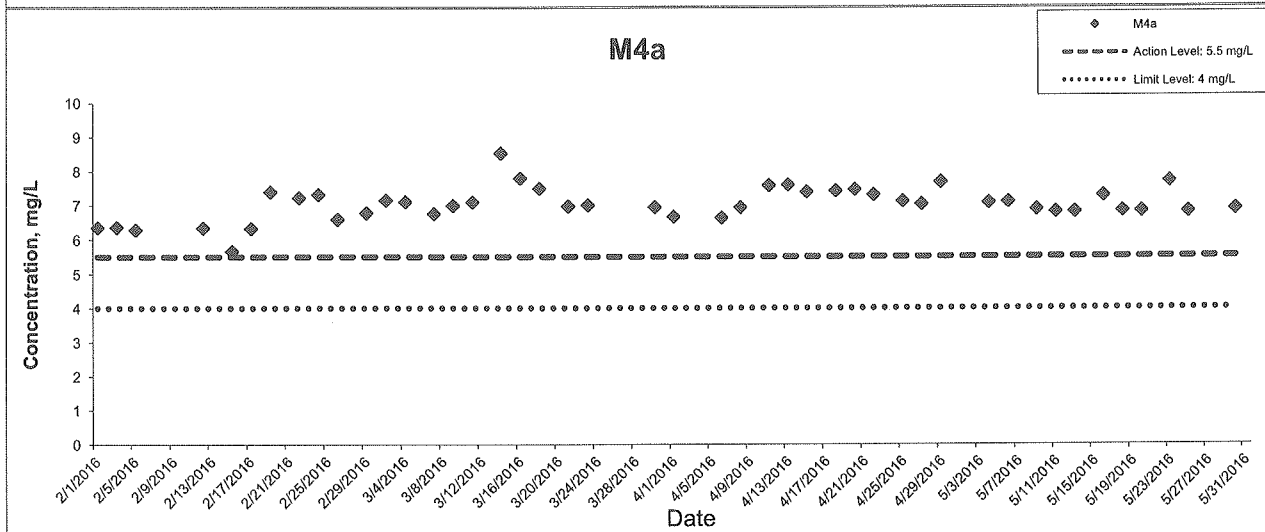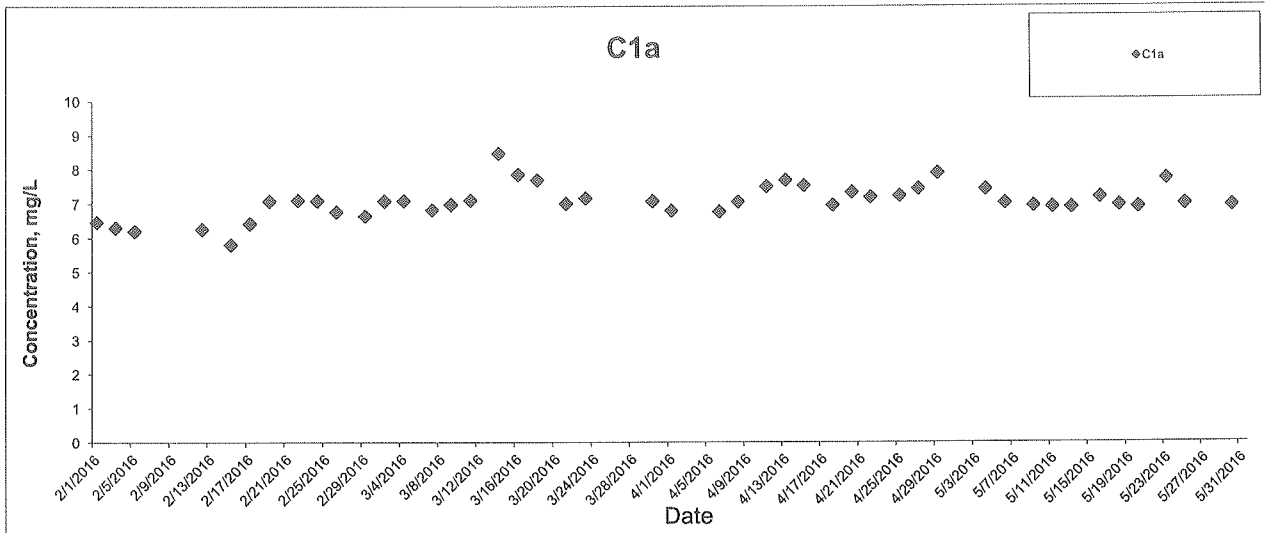




Dissolved Oxygen (Bottom) at Mid-Ebb Tide

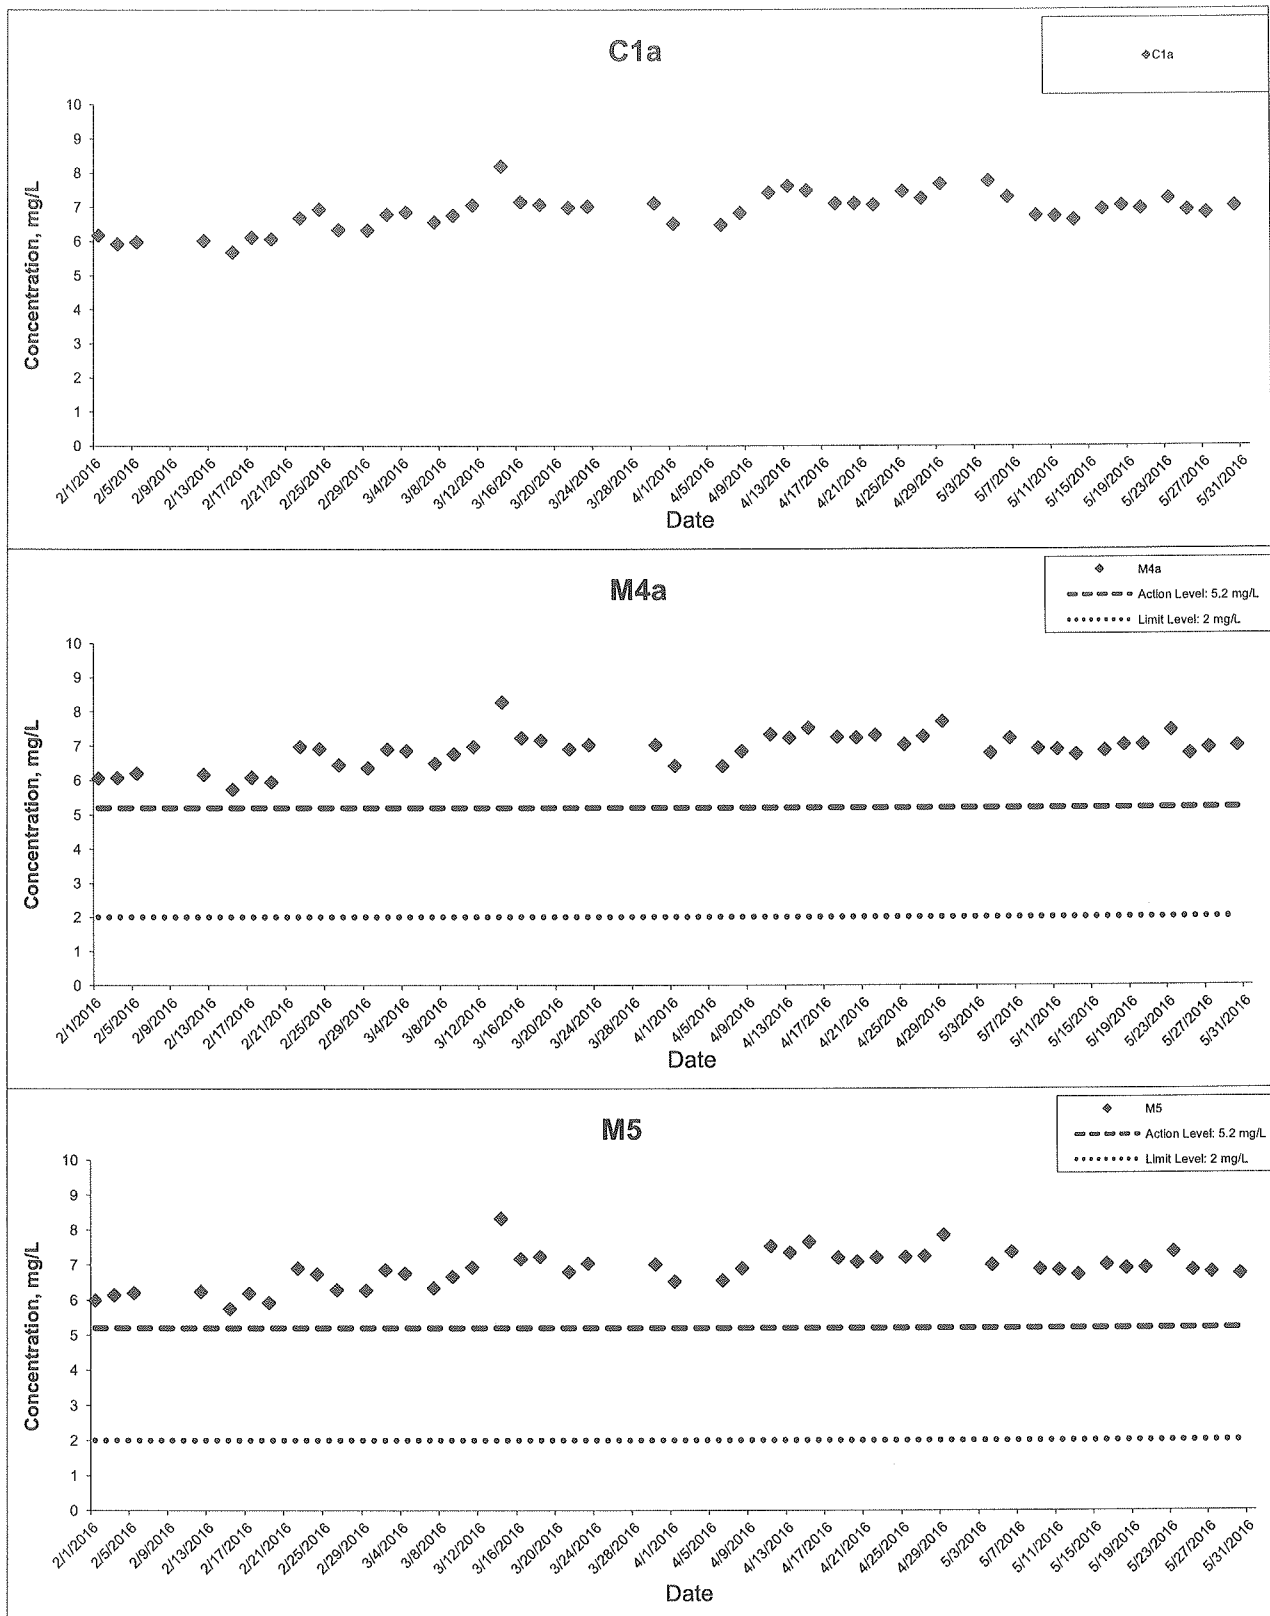




Dissolved Oxygen (Bottom) at Mid-Flood Tide

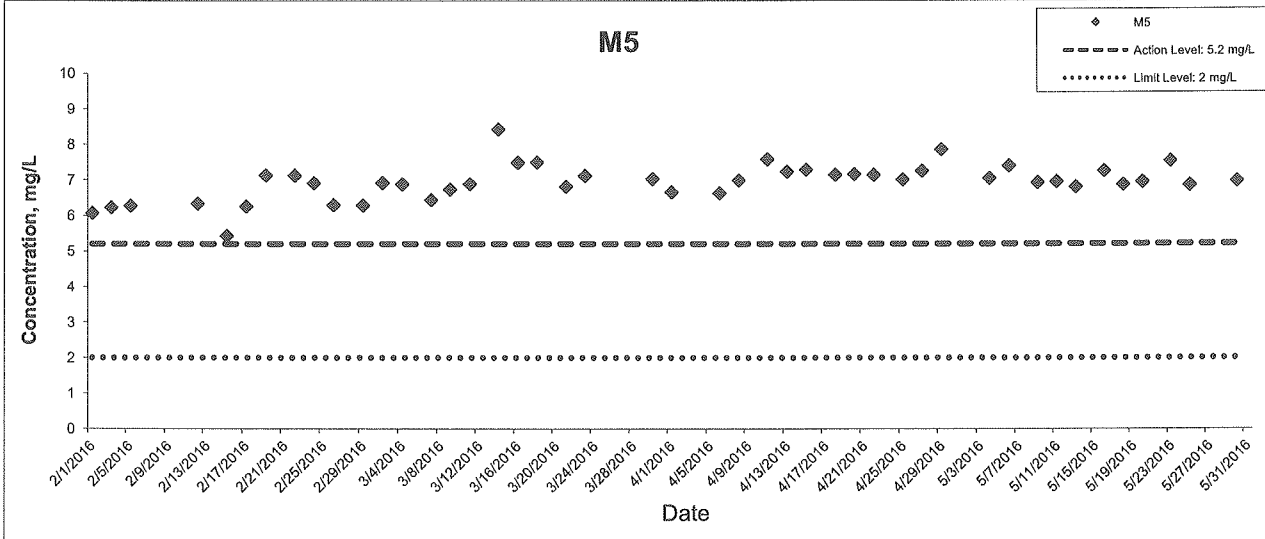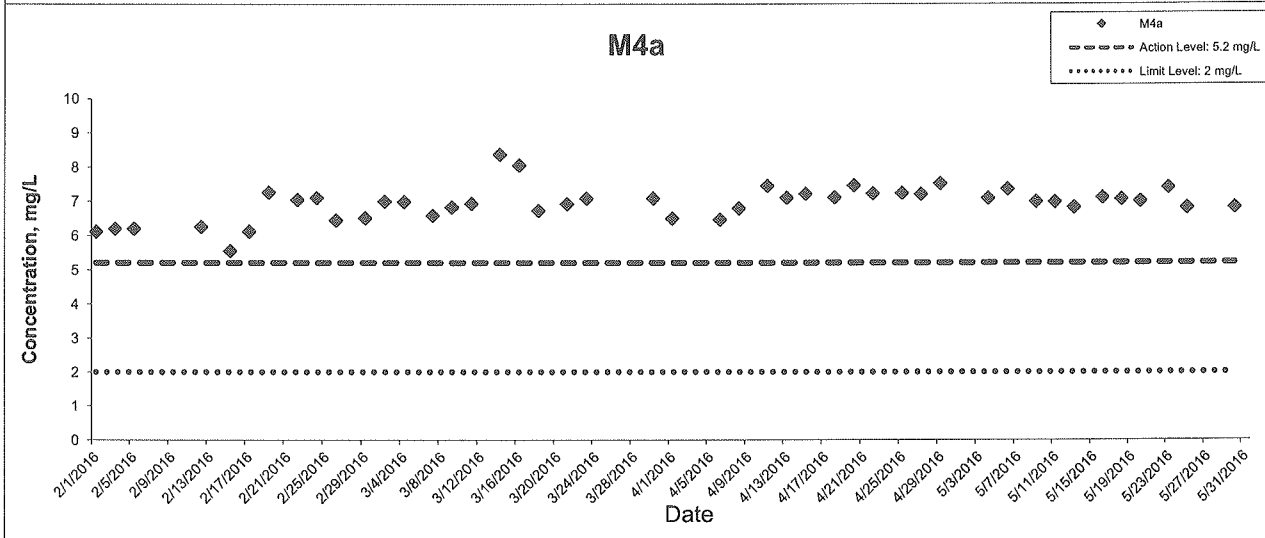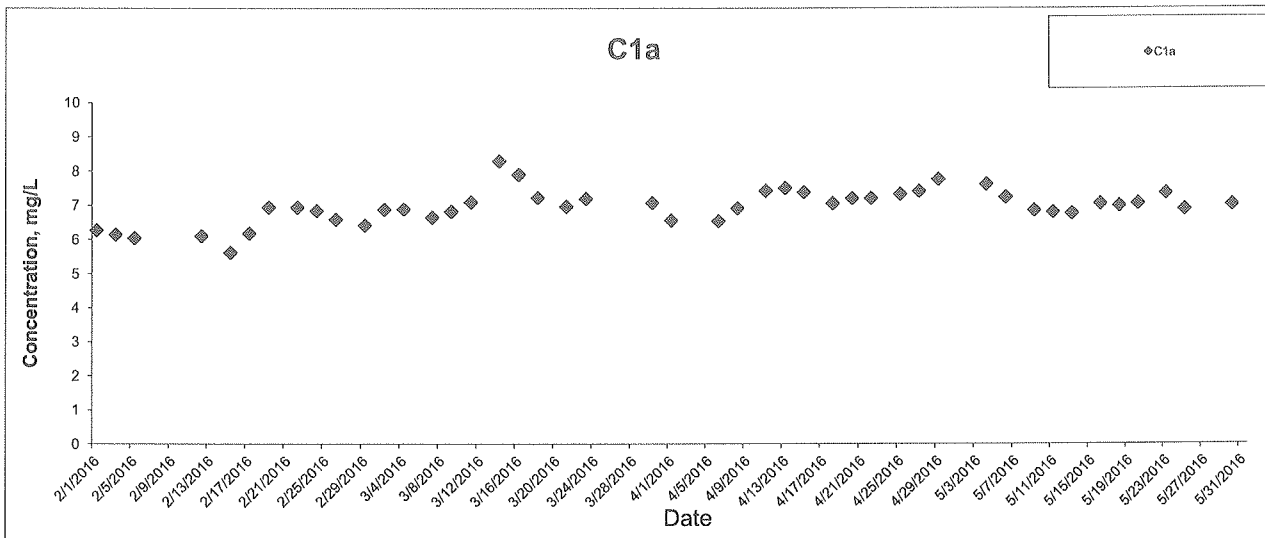




Turbidity at Mid-Ebb Tide

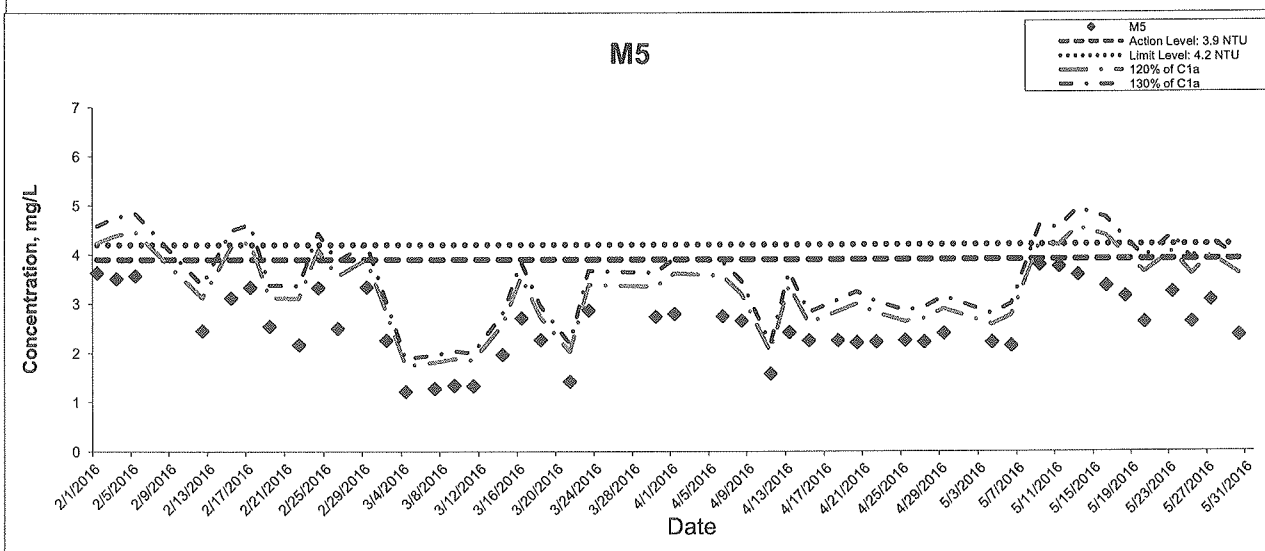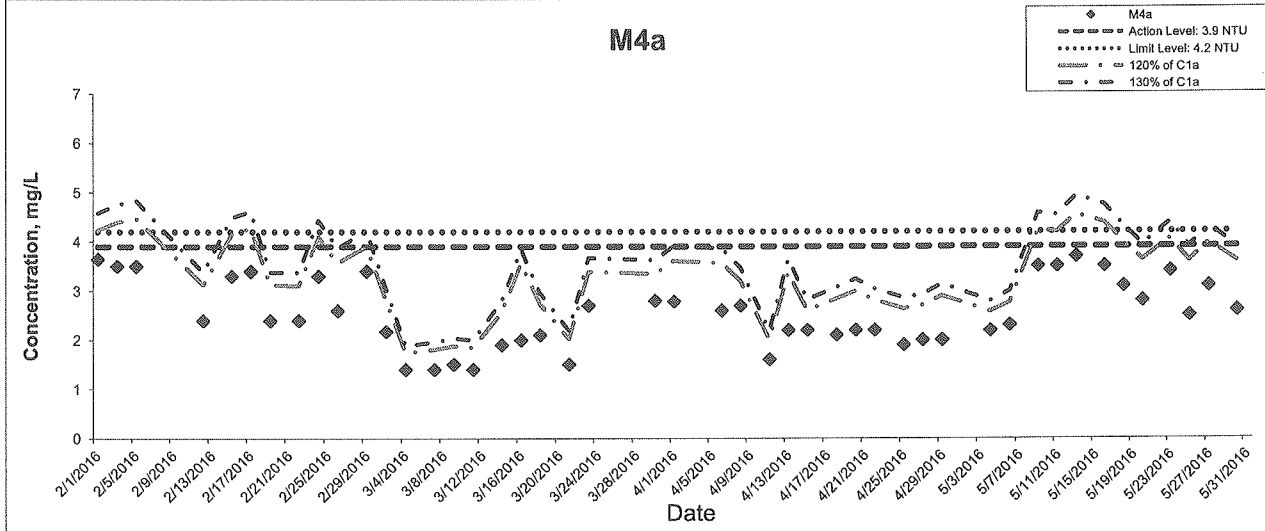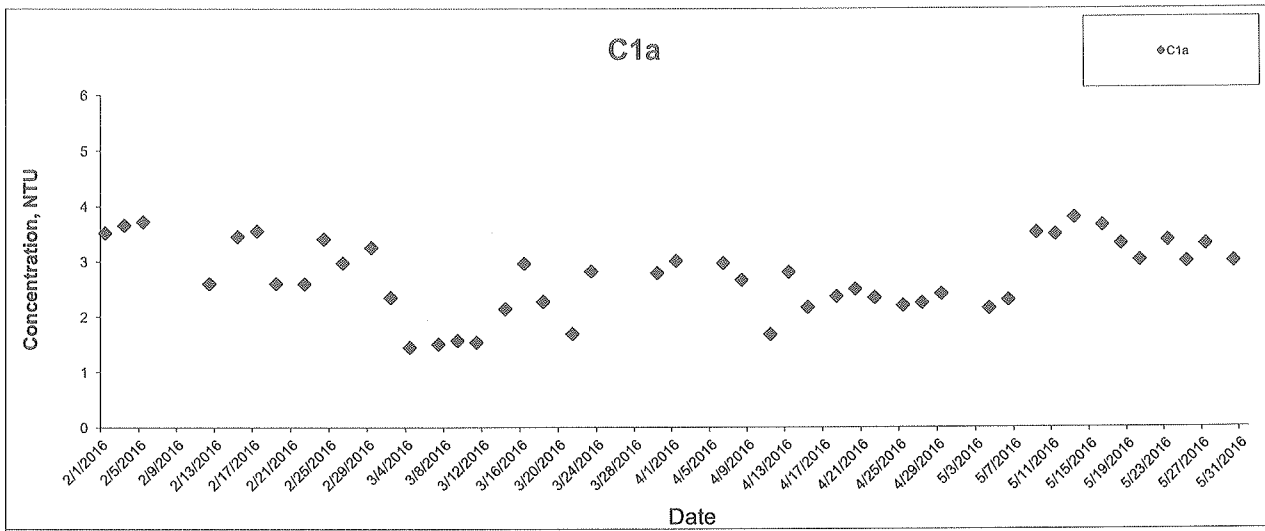




Turbidity at Mid-Flood Tide

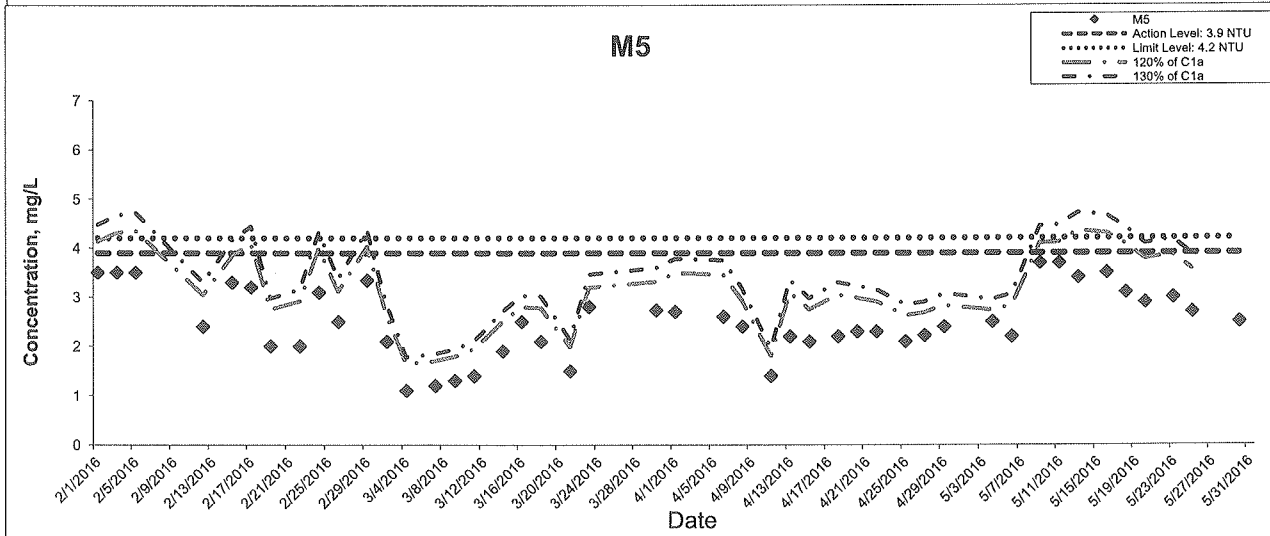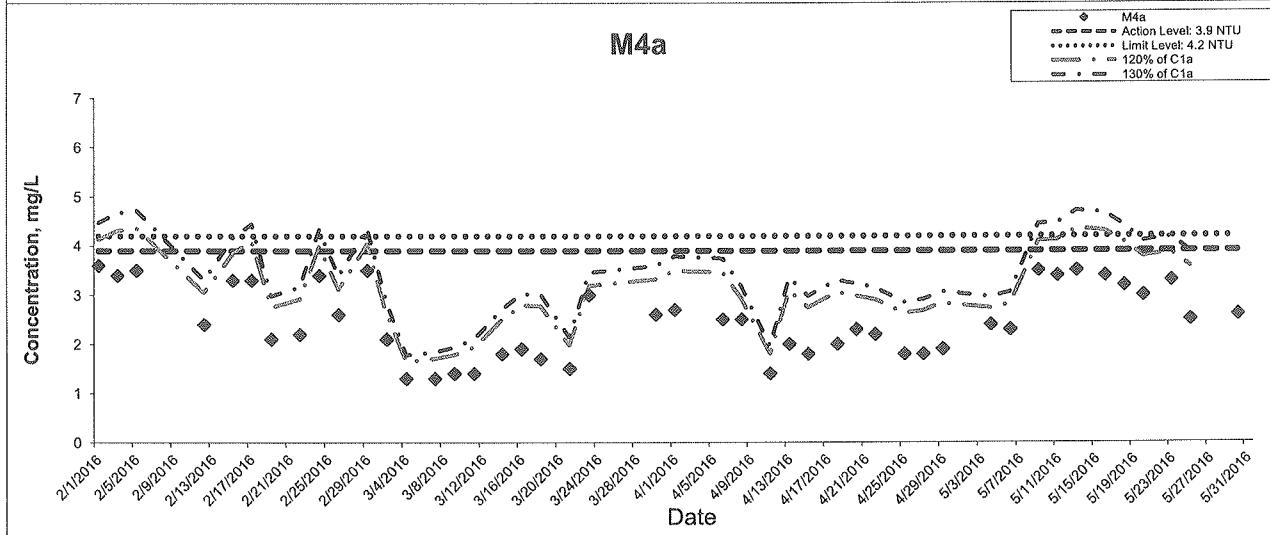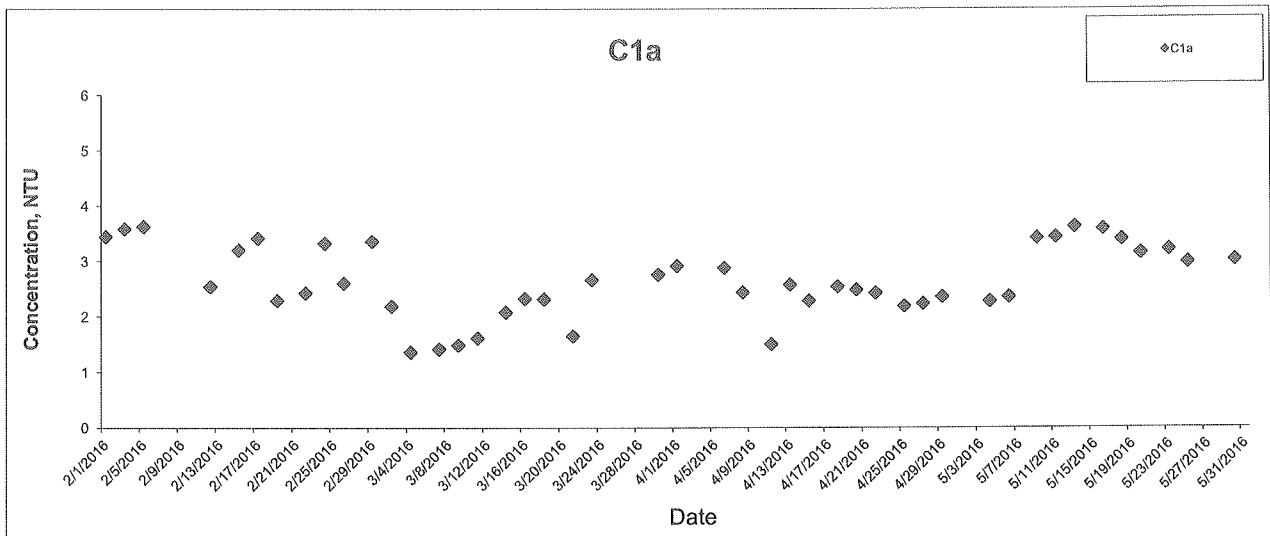

Suspended Solids at Mid-Ebb Tide

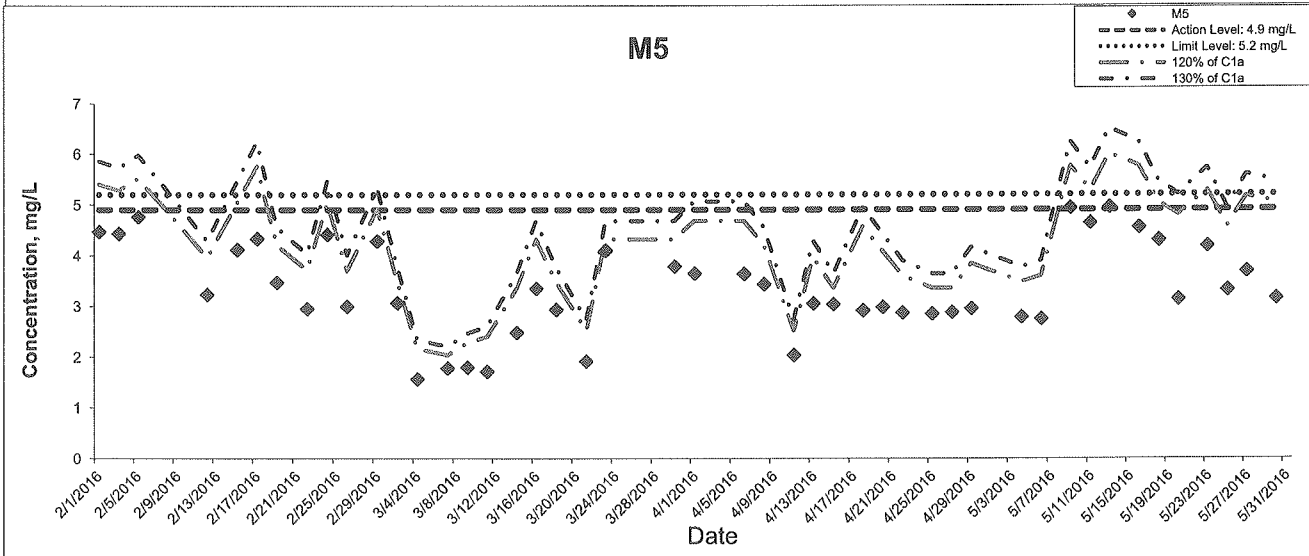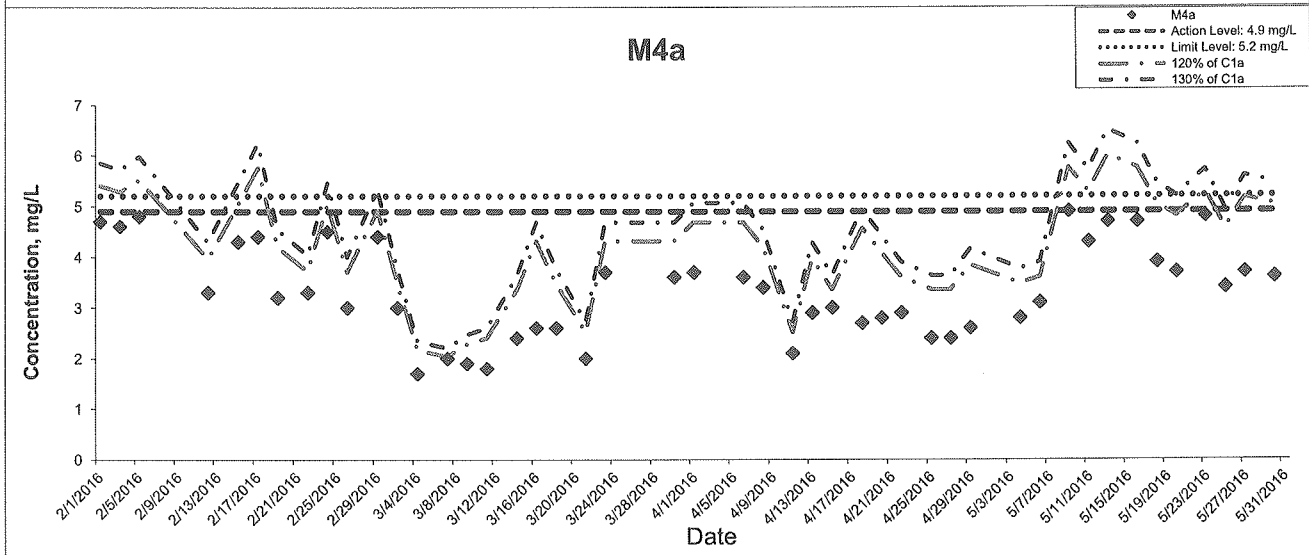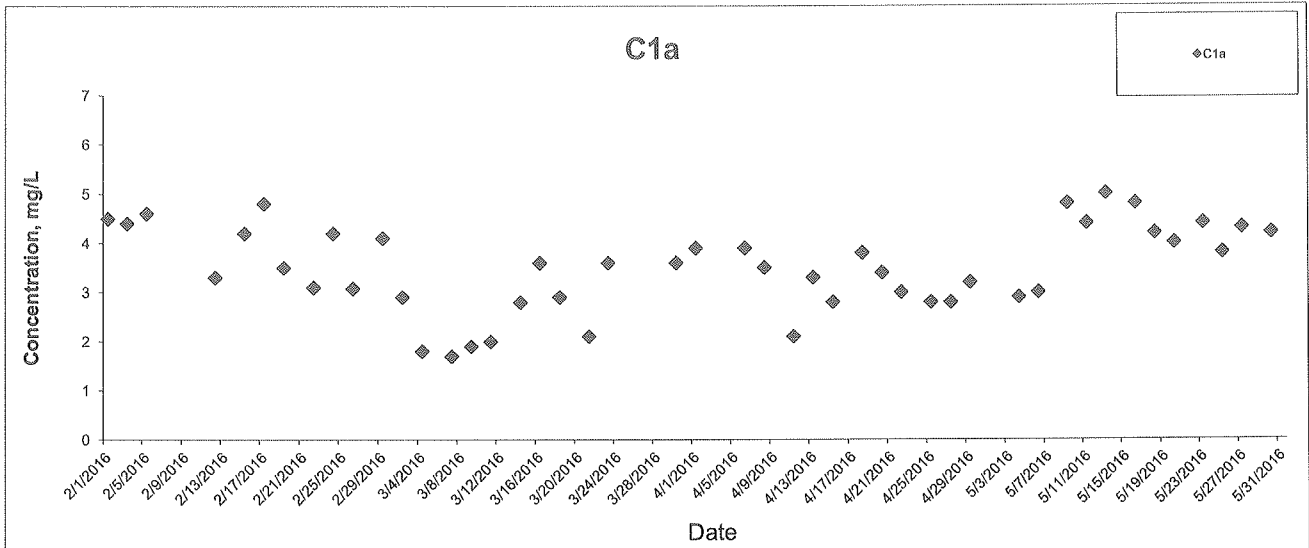

Suspended Solids at Mid-Flood Tide

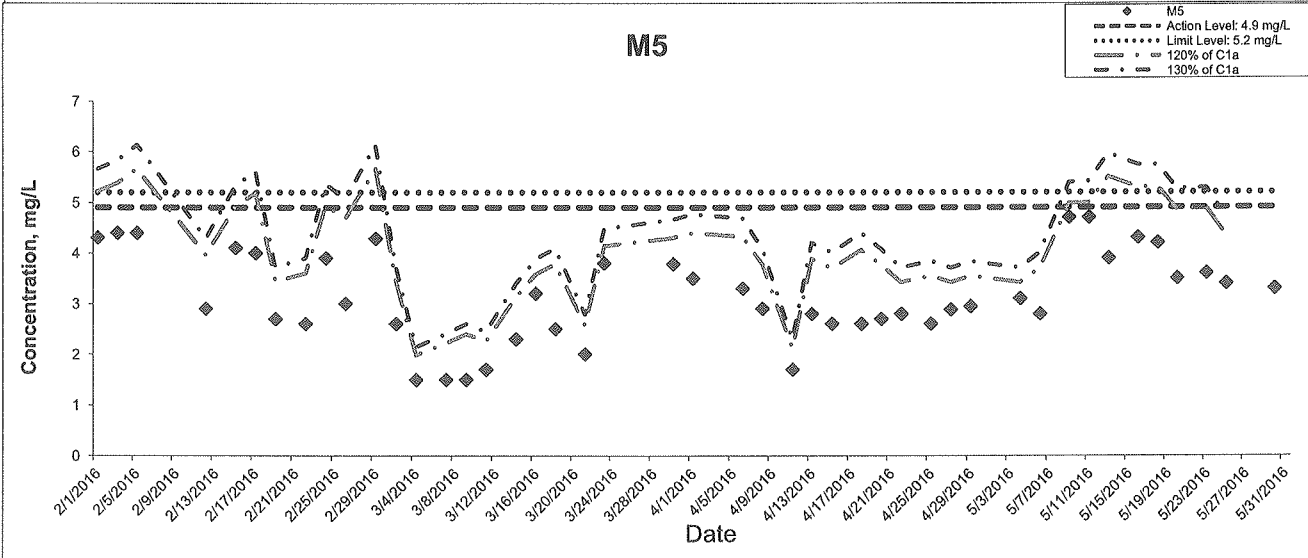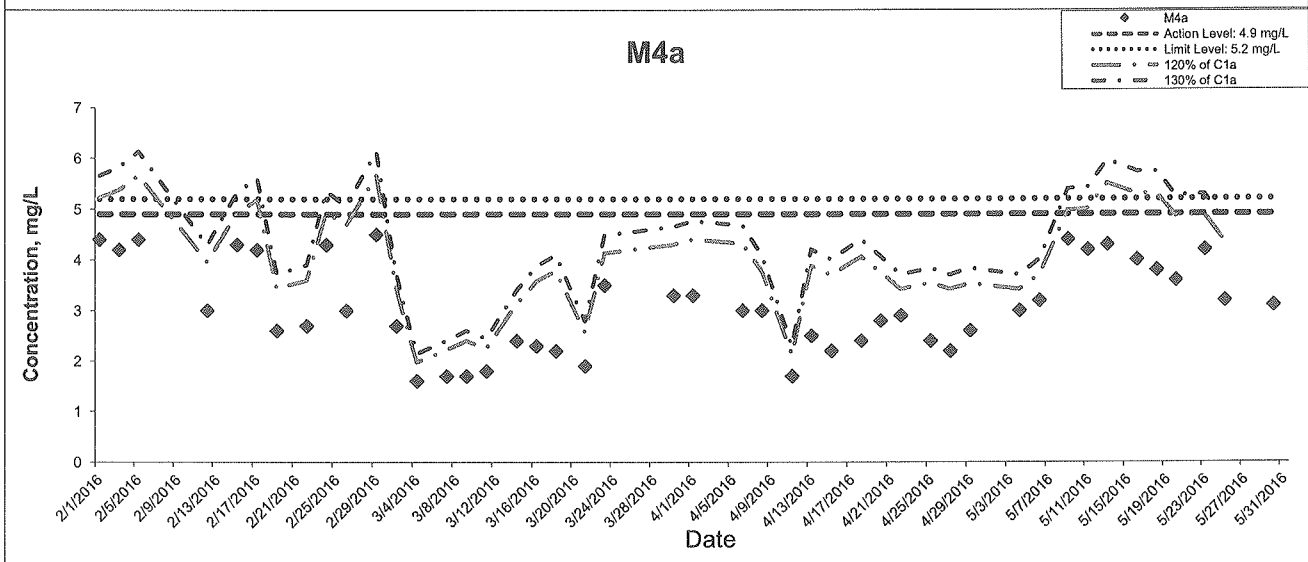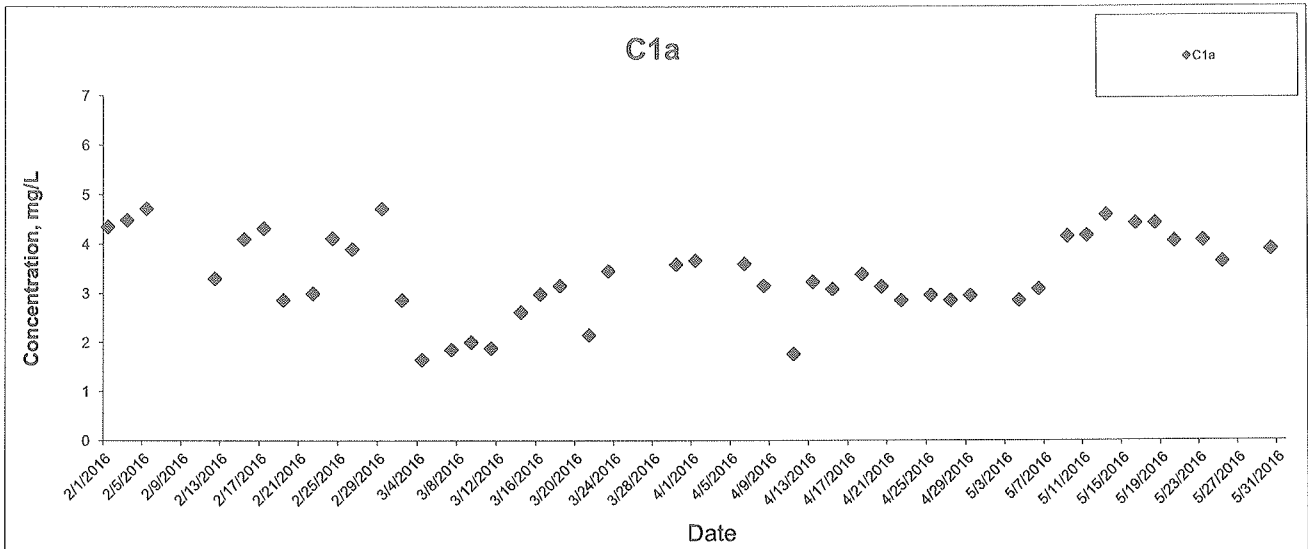

**APPENDIX D
QA/QC REPORT**

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/4/2016	107.9	FC1a-S1	3.77	EC1a-S2	99.5
	97.6	EC1a-M1	8	EWM5-B2	94.8

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/6/2016	103.1	FC1a-S1	6.90	EC1a-S2	108.0
	98.7	EC1a-M1	6.06	EWM5-B2	104.2

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/9/2016	98.7	FC1a-S1	8.51	EC1a-S2	97.4
	93.5	EC1a-M1	2.06	EWM5-B2	101.4

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/11/2016	102.2	FC1a-S1	4.65	EC1a-S2	102.0
	94.0	EC1a-M1	7.59	EWM5-B2	94.0

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/13/2016	104.4	FC1a-S1	8.51	EC1a-S2	97.4
	101.2	EC1a-M1	2.06	EWM5-B2	101.4

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/16/2016	102.3	FC1a-S1	7.06	EC1a-S2	92.6
	98.0	EC1a-M1	6.59	EWM5-B2	107.4

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/18/2016	99.7	FC1a-S1	2.82	EC1a-S2	92.6
	92.7	EC1a-M1	6.59	EWM5-B2	107.4

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/20/2016	104.2	FC1a-S1	5.41	EC1a-S2	102.5
	101.6	EC1a-M1	4.17	EWM5-B2	102.5

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling	QC Sample	Sample Duplicate	Sample Spike
----------	-----------	------------------	--------------

Sampling Date	QC Sample % Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/23/2016	102.8	FC1a-S1	8.89	EC1a-S2	105.2
	103.0	EC1a-M1	4.88	EWM5-B2	101.0

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/25/2016	94.8	FC1a-S1	4.76	EC1a-S2	96.0
	106.2	EC1a-M1	2.67	EWM5-B2	107.1

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/27/2016	106.6	EC1a-S1	4.65	EWM5-B2	97.1

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.

QA/QC Results of Laboratory Analysis of Total Suspended Solids

Sampling Date	QC Sample	Sample Duplicate		Sample Spike	
	% Recovery *	Sample ID	% Error #	Sample ID	% Recovery @
5/30/2016	99.0	FC1a-S1	4.44	EC1a-S2	94.8
	94.1	EC1a-M1	4.08	EWM5-B2	107.8

Note: (*) % Recovery of QC sample should be between 80% to 120%.
 (#) % Error of Sample Duplicate should be between 0% to 10%.
 (@) % Recovery of Sample Spike should be between 80% to 120%.
 (**) % Error of Sample Duplicate >10% but invalid due to sample results less than PQL.