

Your ref.

Our ref.

5126871/19.10/OC049/SO/EK

Date:

15 July 2015

ATKINS 香港九龍尖流

阿特金斯

香港九龍尖沙咀海港城 九倉電訊中心十三樓 13/F Wharf T&T Centre Harbour City Tsim Sha Tsui Kowloon Hong Kong

Telephone (852) 2972 1000 Facsimile (852) 2890 6343

www.atkinsglobal.com

By Post and e-mail (Donald.lp@lcwjv.com)

Leighton – Chun Wo Joint Venture 39/F Sun Hung Kai Centre 30 Harbour Road Hong Kong

Attn: Mr. Donald Ip

Dear Mr. Ip,

Contract No. HY/2013/01 Hong Kong – Zhuhai – Macao Bridge Hong Kong Boundary Crossing Facilities – Passenger Clearance Building Certification of Quarterly EM&A Report No.3 (Revision 1)

Atkins China Ltd. certifies, in the capacity of Environmental Team Leader, that the Quarterly EM&A Report No.3 (Revision 1), in principle, conforms the requirements provided in Section 16.4 of the Updated Environmental Monitoring and Audit Manual for HKBCF (Version1.0).

Yours faithfully for and on behalf of Atkins China Ltd

Sharifah OR

Environmental Team Leader

CC.

1. AECOM - Mr. Darrel Kingan (By Fax.: 3468 2076)

2. ENPO/IEC - Mr. Raymond Dai & Mr. Y.H. Hui (By Fax.: 3465 2899)



Ref.: HYDHZMBEEM00_0_3163L.15

15 July 2015

By Fax (3468 2076) and By Post

AECOM Asia Co. Ltd. The PRE's Offices 5 Ying Hei Road, Tung Chung, Lantau Hong Kong

Attention: Mr. Darrel Paul Kingan

Dear Sir,

Re: Agreement No. CE 48/2011 (EP)

Environmental Project Office for the

HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing Facilities,

and Tuen Mun-Chek Lap Kok Link - Investigation

Contract No. HY/2013/01 - HZMB HKBCF - Passenger Clearance Building Quarterly EM&A Report No. 3 for April 2015 to June 2015

Reference is made to the Environmental Team's submission of Quarterly Environmental Monitoring & Audit Report No. 3 for April 2015 to June 2015 (Revision 1) certified by the ET Leader (ET's ref.: "5126871/19.10/OC049/SO/EK" dated 15 July 2015) and provided to us via e-mail on 15 July 2015.

We are pleased to inform you that we have no adverse comment on the captioned Quarterly EM&A Report for April 2015 to June 2015.

Thank you very much for your attention and please feel free to contact the undersigned should you require further information.

Yours faithfully, For and on behalf of Ramboll Environ Hong Kong Limited

Raymond Dai

Konjul

Independent Environmental Checker

c.c. HyD Mr. Matthew Fung (By Fax: 3188 6614)
HyD Ms. Lowell Chiu (By Fax: 3188 6614)
Atkins Ms. Sharifah Or (By Fax: 2890 6343)
LCWJV Mr. Gary Wong (By Fax: 3621 0180)

Internal: DY, YH, SL, JM, LP, ENPO Site

Q:\Projects\HYDHZMBEEM00\02_Proj_Mgt\02_Corr\HYDHZMBEMM00_0_3163L.15.doc



Contract No. HY/2013/01

Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities – Passenger Clearance Building

Quarterly EM&A Report No.3 (Covering the Period from 1 April 2015 to 30 June 2015)

15 July 2015

Revision 1

Main Contractor



Environmental Team





Contents

Executive Summary

1	Introdu	ction	1
1.1		Basic Project Information	1
1.2		Project Organisation	
1.3		Construction Programme	
1.4		Construction Works Undertaken During the Reporting Period	2
2	EM&A	Requirement	3
2.1		Summary of EM&A Requirements	3
2.2		Monitoring Requirements	3
2.3		Action and Limit Levels	4
2.4		Event Action Plans	4
2.5		Mitigation Measures	4
3	Enviro	nmental Monitoring and Audit	5
3.1		Air Quality Monitoring Results	5
3.2		Noise Monitoring Results	5
3.3		Implementation of Environmental Measures	5
3.4		Advice on the Solid and Liquid Waste Management Status	5
3.5		Environmental Licenses and Permits	5
4	Summa	ary of Exceedance, Complaint, Notification of Summons and Successful Prosecution	6
4.1		Summary of Exceedance of the Environmental Quality Performance Limit	6
4.2		Summary of Complaints, Notification of Summons and Successful Prosecution	6
5	Comme	ents, Recommendations and Conclusion	7
5.1		Comments	7
5.2		Recommendations	7
5.3		Conclusions	8
Figu Figur Figur		Location of Air Quality Monitoring Stations Location of Noise Monitoring Stations	
Appe Appe Appe Appe Appe Appe Appe Appe	endices ndix A ndix B ndix C ndix D ndix E ndix F ndix G ndix H	Location of Works Areas Project Organization for Environmental Works Construction Programme Event and Action Plan Implementation Schedule for Environmental Mitigation Measures (EMIS) Site Audit Findings and Corrective Actions Waste flow Table Environmental Licenses and Permits	
Appe	ndix l	Statistics on Environmental Complaints, Notification of Summons and Successful Prosecution	ns

Executive Summary

This Quarterly Environmental Monitoring and Audit (EM&A) Report is prepared for Contract HY/2013/01 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) – Passenger Clearance Building (hereafter referred to as "the Contract") for the Highways Department of Hong Kong Special Administrative Region (HKSAR). The Contract was awarded to Leighton – Chun Wo Joint Venture (hereafter referred to as "the Contractor") and Atkins China Limited was appointed as the Environmental Team (ET) by the Contractor.

The Contract is part of Hong Kong – Zhuhai – Macao Bridge HKBCF which is a "Designated Project", under Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO) (Cap 499) and Environmental Impact Assessment (EIA) Report (Register No. AEIAR-145/2009) was prepared for the Project. The current Environmental Permit (EP) No. EP-353/2009/H for HKBCF was issued on 19 January 2015. These documents are available through the EIA Ordinance Register. Site preparation works of the Contract started on 26 September 2014 and the construction works of the Contract commenced on 6 October 2014.

Atkins China Limited has been appointed by the Contractor to implement the Environmental Monitoring & Audit (EM&A) programme for the Contract in accordance with the Updated EM&A Manual for HKBCF (Version1.0) and will be providing environmental team services to the Contract.

This is the third Quarterly EM&A Report for the Contract which summaries findings of the EM&A works during the reporting period from 1 April 2015 to 30 June 2015.

Environmental Monitoring and Audit Progress

The EM&A programme was undertaken in accordance with the Updated EM&A Manual for HKBCF (Version 1.0). It should be noted that the air quality and noise monitoring works for the Contract are covered by Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge HKBCF – Reclamation Works and Contract No. HY/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between Scenic Hill and HKBCF. The ET of the Contract or another ET of the HZMB project is required to conduct impact air quality monitoring at AMS6, AMS7A and noise monitoring at NMS2 and NMS3B as part of EM&A programme if these monitoring stations are no longer covered under Contract Nos. HY/2010/02 and HY/2011/03. However, this is subject to ENPO's final decision on which ET should carry out the monitoring work at these stations.

The dates of environmental site inspection during the reporting period are listed below:

	Environmental Site Inspection Date	
April 2015	May 2015	June 2015
1, 8, 15, 22 and 29	6, 13, 20 and 27	3, 10, 17, 24 and 30

Breaches of Action and Limit Levels

Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at station AMS6 shall be referred to the monthly EM&A Reports (for April, May and June 2015) prepared by Contract No. HY/2011/03.

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.

There was no Action and Limit Level exceedance for noise recorded at NMS2 and NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.

Implementation of Environmental Measures

Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. Potential environmental impacts due to the construction activities were monitored and reviewed.

Complaint Log

There was one complaint received in relation to the environmental impact during the reporting period.



Environmental Complaint No.	Date of Complaint Received	Description of Environmental Complaints
001	22 May 2015	Air Quality and Noise

After investigation, there is no sufficient evidence to justify the concerned dark smoke and noise nuisance are related to Contract No. HY/2013/01.

Notifications of Summons and Successful Prosecutions

There was no notification of summon or prosecution received during this reporting period.

Reporting Change

There was no reporting change during the reporting period.



1 Introduction

1.1 Basic Project Information

- 1.1.1 This Quarterly Environmental Monitoring and Audit (EM&A) Report is prepared for Contract HY/2013/01 Hong Kong-Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities Passenger Clearance Building (hereafter referred to as "the Contract") for the Highways Department of Hong Kong Special Administrative Region. The Contract was awarded to Leighton Chun Wo Joint Venture (hereafter referred to as "the Contractor") and Atkins China Limited was appointed as the Environmental Team (ET) by the Contractor.
- 1.1.2 The Contract is part of Hong Kong Zhuhai Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) which is a "Designated Project", under Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO) (Cap 499). An Environmental Impact Assessment (EIA) Report (Register No. AEIAR-145/2009) was prepared for the Project. The current Environmental Permit (EP) No. EP-353/2009/H for HKBCF was issued on 19 January 2015. These documents are available through the EIA Ordinance Register. Site preparation work of the Contract started on 26 September 2014 and the construction works of the Contract commenced on 6 October 2014. The works areas of the Contract are shown in **Appendix A**.
- 1.1.3 This is the third Quarterly EM&A Report for the Contract which summarizes the audit findings of the EM&A programme during the reporting period from 1 April 2015 to 30 June 2015.

1.2 Project Organisation

1.2.1 The project organization structure and lines of communication with respect to the on-site environmental management structure is shown in **Appendix B**. The key personnel contact names and numbers are summarized in **Table 1.1**.

Table 1.1 Contact Information of Key Personnel

Party	Position	Name	Telephone	Fax
Engineer or Engineer's Representative (AECOM Asia Co. Ltd.)	Chief Resident Engineer	Darrel Kingan	3958 7339	3468 2076
Environmental Project Office / Independent Environmental Checker	Environmental Project Office Leader	Y. H. Hui	3465 2888	3465 2899
(Ramboll Environ Hong Kong Limited)	Independent Environmental Checker	Raymond Dai	3465 2888	3465 2899
Contractor	Project Manager	Gary Wong	3143 7013	3621 0180
(Leighton – Chun Wo Joint Venture)	Environmental Officer	Donald Ip	6461 8635	3621 0180
Environmental Team (Atkins China Limited)	Environmental Team Leader	Sharifah Or	2972 1802	2890 6343
24 hours complaint hotline			3958 7300	

1.3 Construction Programme

1.3.1 A copy of the Contractor's construction programme is provided in **Appendix C**.

1.4 Construction Works Undertaken During the Reporting Period

- 1.4.1 A summary of the construction activities undertaken during this reporting period is shown below:
 - Pile Testing at WA1;
 - Piling Works at WA1;
 - Pre-drilling Works at WA1;
 - Socket H Piles Works at WA1;
 - · Fiction H-Piles Works at WA1;
 - Bulk Excavation at WA1;
 - · Pile Cropping and Pile Capping Works at WA1;
 - · Temporary Haul Road Construction at WA1; and
 - Cement Solidification/Stabilization Work for Excavated Marine Sediment at WA1 and Portion B of Contract No. HY/2010/02.



2 EM&A Requirement

2.1 Summary of EM&A Requirements

- 2.1.1 The EM&A programme was undertaken in accordance with the Updated EM&A Manual for HKBCF (Version 1). It should be noted that the air quality and noise monitoring works for the Contract are covered by Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge HKBCF Reclamation Works and Contract No. HY/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road Section between Scenic Hill and HKBCF. The ET of the Contract or another ET of the HZMB project is required to conduct impact air quality monitoring at AMS6 and AMS7A and noise monitoring at NMS2 and NMS3B as part of EM&A programme if these monitoring stations are no longer covered under Contract Nos. HY/2010/02 and HY/2011/03. However, this is subject to ENPO's final decision on which ET should carry out the monitoring work at these stations.
- 2.1.2 The permission to carry out impact air monitoring work at AMS7 (Hong Kong SkyCity Marriott Hotel) was not granted after 31 January 2015. The impact air quality monitoring location (AMS7) was relocated to a nearby air sensitive receiver, Chu Kong Air-Sea Union Transportation Co. Ltd. (AMS7A), from 5 February 2015. The alternative location was approved by EPD on 5 February 2015. The baseline and action/limit level for air quality as derived from the baseline monitoring data recorded at Hong Kong SkyCity Marriott Hotel (AMS7) was adopted for the alternative air quality location.
- 2.1.3 A summary of air and noise monitoring locations are presented in **Table 2.1**. The location of air quality and noise monitoring stations are shown as in **Figure 2.1** and **Figure 2.2**, respectively.

Table 2.1 Summary of Impact EM&A Requirement	Table 2.1	Summary	of Impact	EM&A F	Requirement
--	-----------	---------	-----------	--------	-------------

Environmental Monitoring	ID	Location Description
Air Quality	AMS 6 ⁽¹⁾	Dragonair/CNAC (Group) Building
All Quality	AMS 7A ^{(1), (2)}	Chu Kong Air-Sea Union Transportation Co. Ltd.
Naisa	NMS2 ⁽³⁾	Seaview Crescent
Noise	NMS3B(3),(4)	Site Boundary of Site Office Area at Works Area WA2

Remarks:

- (1) The ET of this Contract should conduct impact air quality monitoring at the AMS listed in the table as part of EM&A programme according to the latest notification from ENPO when the monitoring station(s) is/are no longer covered by another ET of the HZMB project.
- (2) The original monitoring location was at Hong Kong SkyCity Marriott Hotel (AMS 7). As the permission to carry out air quality monitoring at Hong Kong SkyCity Marriott Hotel was not granted after 31 January 2015, the monitoring location has been relocated to Chu Kong Air-Sea Union Transportation Co. Ltd. since 5 February 2015. The alternative monitoring location was approved by EPD on 5 February 2015.
- (3) The ET of this Contract should conduct impact noise monitoring at the NMS listed in the table as part of EM&A programme according to the latest notification from ENPO when the monitoring station(s) is/are no longer covered by another ET of the HZMB project.
- (4) The Action and Limit Levels for schools will be applied for this alternative monitoring location.

2.2 Monitoring Requirements

2.2.1 The monitoring requirements, monitoring equipment, monitoring parameters, frequency and duration, monitoring methodology, monitoring schedule, meteorological information are detailed in the monthly EM&A Reports prepared for Contract Nos. HY/2010/02 and HY/2011/03.



2.3 Action and Limit Levels

2.3.1 The Action and Limit Level for 1-hr TSP and 24-hr TSP are provided in **Table 2.2** and **Table 2.3**, respectively.

Table 2.2 Action and Limit Levels for 1-hour TSP

Monitoring Station	Action Level, μg/m³	Limit Level, μg/m³
AMS 6 – Dragonair/CNAC (Group) Building (HKIA)	360	
AMS 7A - Chu Kong Air-Sea Union Transportation Co. Ltd	370	500

Table 2.3 Action and Limit Levels for 24-hour TSP

Monitoring Station	Action Level, μg/m³	Limit Level, µg/m³
AMS 6 – Dragonair/CNAC (Group) Building (HKIA)	173	
AMS 7A - Chu Kong Air-Sea Union Transportation Co. Ltd	183	260

- 2.3.2 If exceedance(s) at these station(s) is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the quarterly EM&A Report.
- 2.3.3 The Action and Limit Levels for construction noise are defined in **Table 2.4**.

Table 2.4 Action and Limit Level for Construction Noise

Parameter	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received	75 dB(A)*

Notes:

If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

2.3.4 If exceedance(s) at these station(s) is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the quarterly EM&A Report.

2.4 Event Action Plans

2.4.1 The Event Actions Plans for air quality and noise are provided in **Appendix D.**

2.5 Mitigation Measures

2.5.1 Environmental mitigation measures for the contract were recommended in the approved EIA Report. **Appendix E** lists the recommended mitigation measures and the implementation status.

^{*} Reduce to 70 dB(A) for schools and 65 dB(A) during school examination period.



3 Environmental Monitoring and Audit

3.1 Air Quality Monitoring Results

- 3.1.1 The monitoring results for AMS6 and AMS7A are reported in the monthly EM&A Reports (for April, May and June 2015) prepared for Contract Nos. HY/2011/03 and HY/2010/02, respectively.
- 3.1.2 Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 shall be referred to the monthly EM&A Reports (for April, May and June 2015) prepared by Contract No. HY/2011/03.
- 3.1.3 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at AMS7A recorded by the ET of Contract No. HY/2010/02 during the reporting period.

3.2 Noise Monitoring Results

- 3.2.1 The monitoring results for NMS2 and NMS3B are reported in the monthly EM&A Reports (for April, May and June 2015) prepared for Contract No. HY/2010/02.
- 3.2.2 No noise exceedances were recorded at stations NMS2 and NMS3B by the ET of Contract No. HY/2010/02 during the reporting period.

3.3 Implementation of Environmental Measures

- 3.3.1 In response to the site audit findings, the Contractor carried out corrective actions. Details of site audit findings and the corrective actions during the reporting period are presented in **Appendix F**.
- 3.3.2 A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in **Appendix E**. Most of the necessary mitigation measures were implemented properly.
- 3.3.3 The Contractor waters 8 times per day on all exposed soil within the Contract site and associated works areas when construction activities are being undertaken.

3.4 Advice on the Solid and Liquid Waste Management Status

- 3.4.1 The Contractor registered as a chemical waste producer for the Contract. Sufficient numbers of receptacles were available for general refuse collection and sorting.
- 3.4.2 Excavated marine sediment is generated and treated using cement solidification/stabilization (Cement S/S) techniques and is reused onsite for either backfilling or landscaping (e.g. berm material) during the reporting period.
- 3.4.3 The summary of waste flow table is detailed in **Appendix G**.
- 3.4.4 The Contractor was reminded that chemical waste containers should be properly treated and stored temporarily in designated chemical waste storage area on site in accordance with the Code of Practise on the Packaging, Labelling and Storage of Chemical Wastes.

3.5 Environmental Licenses and Permits

3.5.1 The valid environmental licenses and permits during the reporting period are summarized in **Appendix H**.



4 Summary of Exceedance, Complaint, Notification of Summons and Successfu Prosecution

4.1 Summary of Exceedance of the Environmental Quality Performance Limit

- 4.1.1 Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 shall be referred to the monthly EM&A Reports (for April, May and June 2015) prepared by Contract No. HY/2011/03.
- 4.1.2 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.
- 4.1.3 There was no Action and Limit Level exceedance for noise recorded at NMS2 and NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.

4.2 Summary of Complaints, Notification of Summons and Successful Prosecution

4.2.1 There was one complaint received during the reporting period. The summary of environmental complaints is presented in **Table 4.1.** The details of cumulative statistics of Environmental Complaints are provided in **Appendix I.**

Table 4.1 A Summary of Environmental Complaints for the Reporting Period

Environmental Complaint No.	Date of Complaint Received	Description of Environmental Complaints
001	22 May 2015	Air Quality and Noise

- 4.2.2 According to ENPO's email to the ET on 22 May 2015, it was noted that EPD had received a complaint regarding the noise nuisance and dark smoke emission during the night time at HKBCF Project work area recently.
- 4.2.3 After investigation, there is no sufficient evidence to justify the concerned dark smoke and noise nuisance are related to Contract No. HY/2013/01. In this case, no follow up action is required. However, the Contractor has been reminded to provide maintenance for all machinery regularly to prevent dark smoke emission and comply with CNP conditions for construction works undertaken during the restricted hours.
- 4.2.4 No notification of summons and prosecution was received during the reporting period.
- 4.2.5 Statistics on notifications of summons and successful prosecutions are summarized in **Appendix I**.

5 Comments, Recommendations and Conclusion

5.1 Comments

- 5.1.1 According to the environmental site inspections undertaken during the reporting period, the following recommendations were provided:
 - The Contractor is recommended to tighten the tarpaulin at the top of shelter for grouting mixing unit.
 - The Contractor is recommended to provide an enclosure (sheltered on the top and 3 sides) for the grouting mixing unit.
 - The Contractor is recommended to place the untreated marine mud within the bund and provide tarpaulin at the bottom of the temporary storage area.
 - The Contractor is recommended to place food waste in enclosed plastic bags before disposing of in the refuse collection skip.
 - The Contractor was reminded to remove the stagnant water inside the drip tray.
 - The contractor was reminded to cover the bags of cement entirely by impervious sheeting or place them in an area sheltered on the top and 3 sides.
 - The Contactor is recommended to provide a drip tray for the chemical containers / diesel drum.
 - The Contractor was reminded to cover cement bags properly.
 - The Contractor was reminded to provide a drain plug for the drip tray.
- 5.1.2 A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in **Appendix E**. Most of the necessary mitigation measures were implemented properly.

5.2 Recommendations

- 5.2.1 With implementation of the recommended environmental mitigation measures, the contract's environmental impacts were considered environmentally acceptable. The weekly environmental site inspections ensured that all the environmental mitigation measures recommended were effectively implemented.
- 5.2.2 The recommended environmental mitigation measures, as included in the EM&A programme, effectively minimize the potential environmental impacts from the contract. Also, the EM&A programme effectively monitored the environmental impacts from the construction activities and ensure the proper implementation of mitigation measures. No particular recommendation was advised for the improvement of the programme.





5.3 Conclusions

- 5.3.1 The site preparation work of the Contract started on 26 September 2014 and the construction works of the Contract commenced on 6 October 2014. This is the third Quarterly EM&A Report summaries findings of the EM&A works during the reporting period from 1 April 2015 to 30 June 2015.
- 5.3.2 Summary of Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level at AMS6 shall be referred to the monthly EM&A Reports (for April, May and June 2015) prepared by Contract No. HY/2011/03.
- 5.3.3 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.
- 5.3.4 There was no Action and Limit Level exceedance for noise recorded at NMS2 and NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.
- 5.3.5 An environmental site inspection was carried out on 1, 8, 15, 22 and 29 April 2015, 6, 13, 20 and 27 May 2015 and 3, 10, 17, 24 and 30 June 2015. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site inspections.
- 5.3.6 There was one complaint received in relation to the environmental impact during the reporting period. After investigation, there is no sufficient evidence to justify the concerned dark smoke and noise nuisance are related to Contract No. HY/2013/01.
- 5.3.7 No notification of summons and successful prosecution was received during the reporting period.

FIGURES



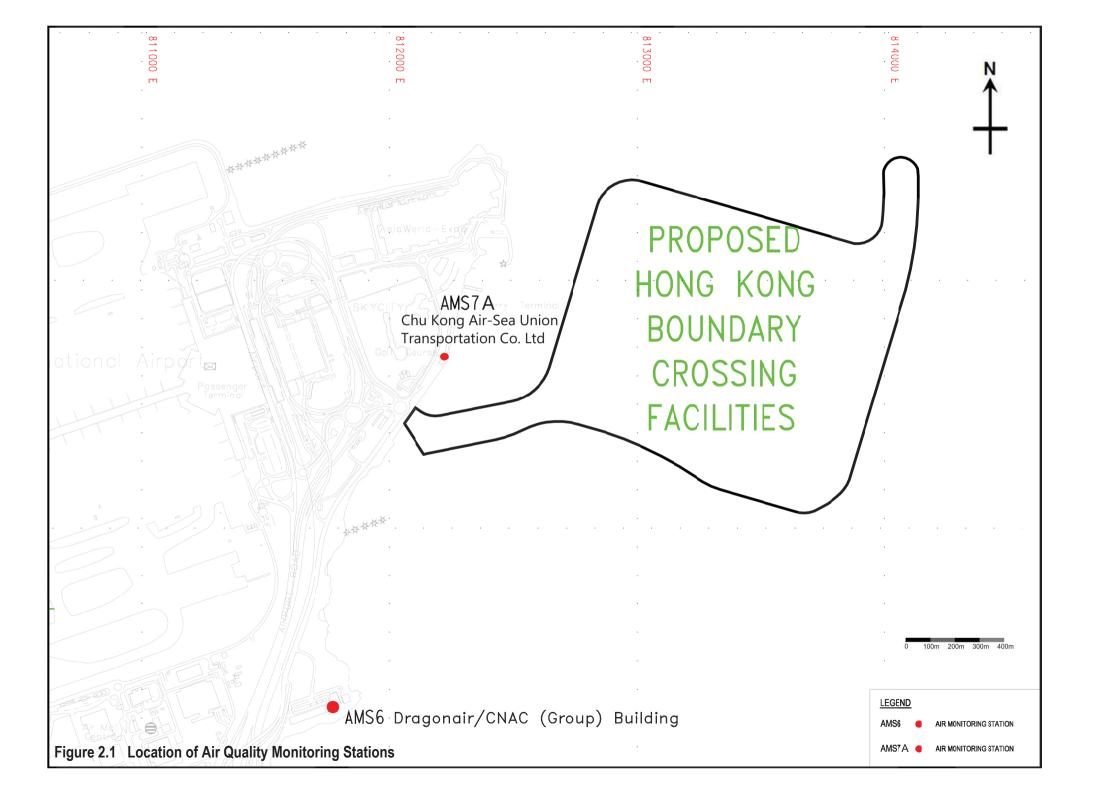

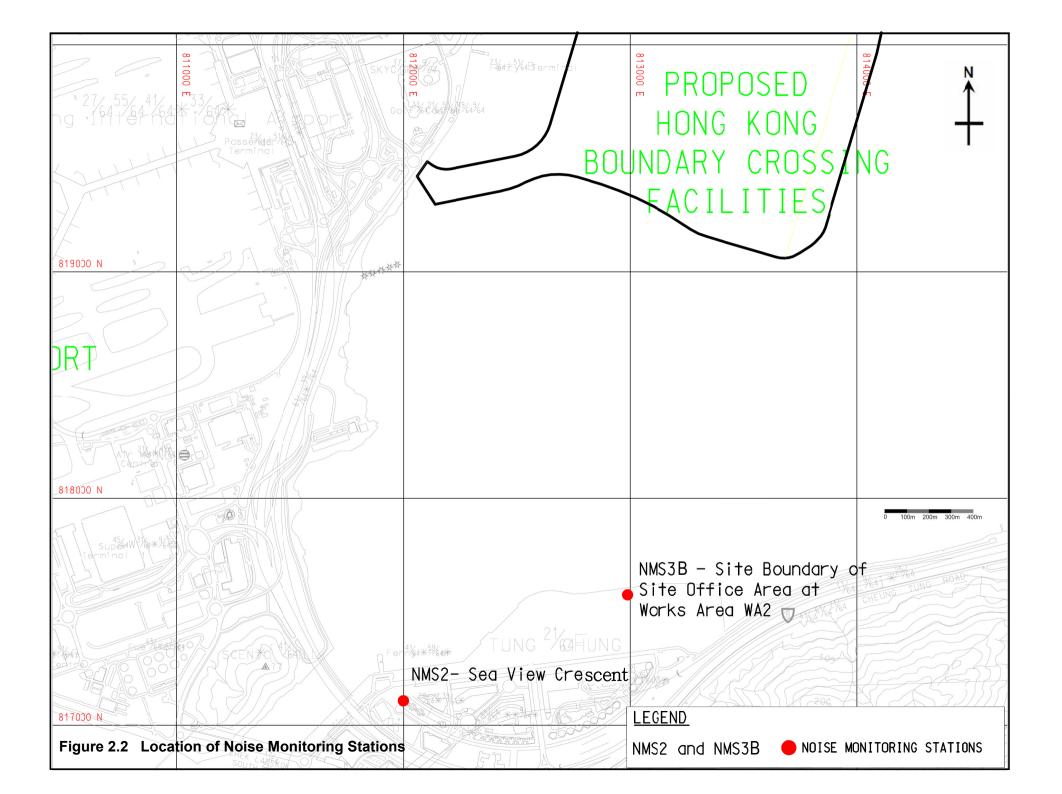






APPENDIX A


Location of Works Areas




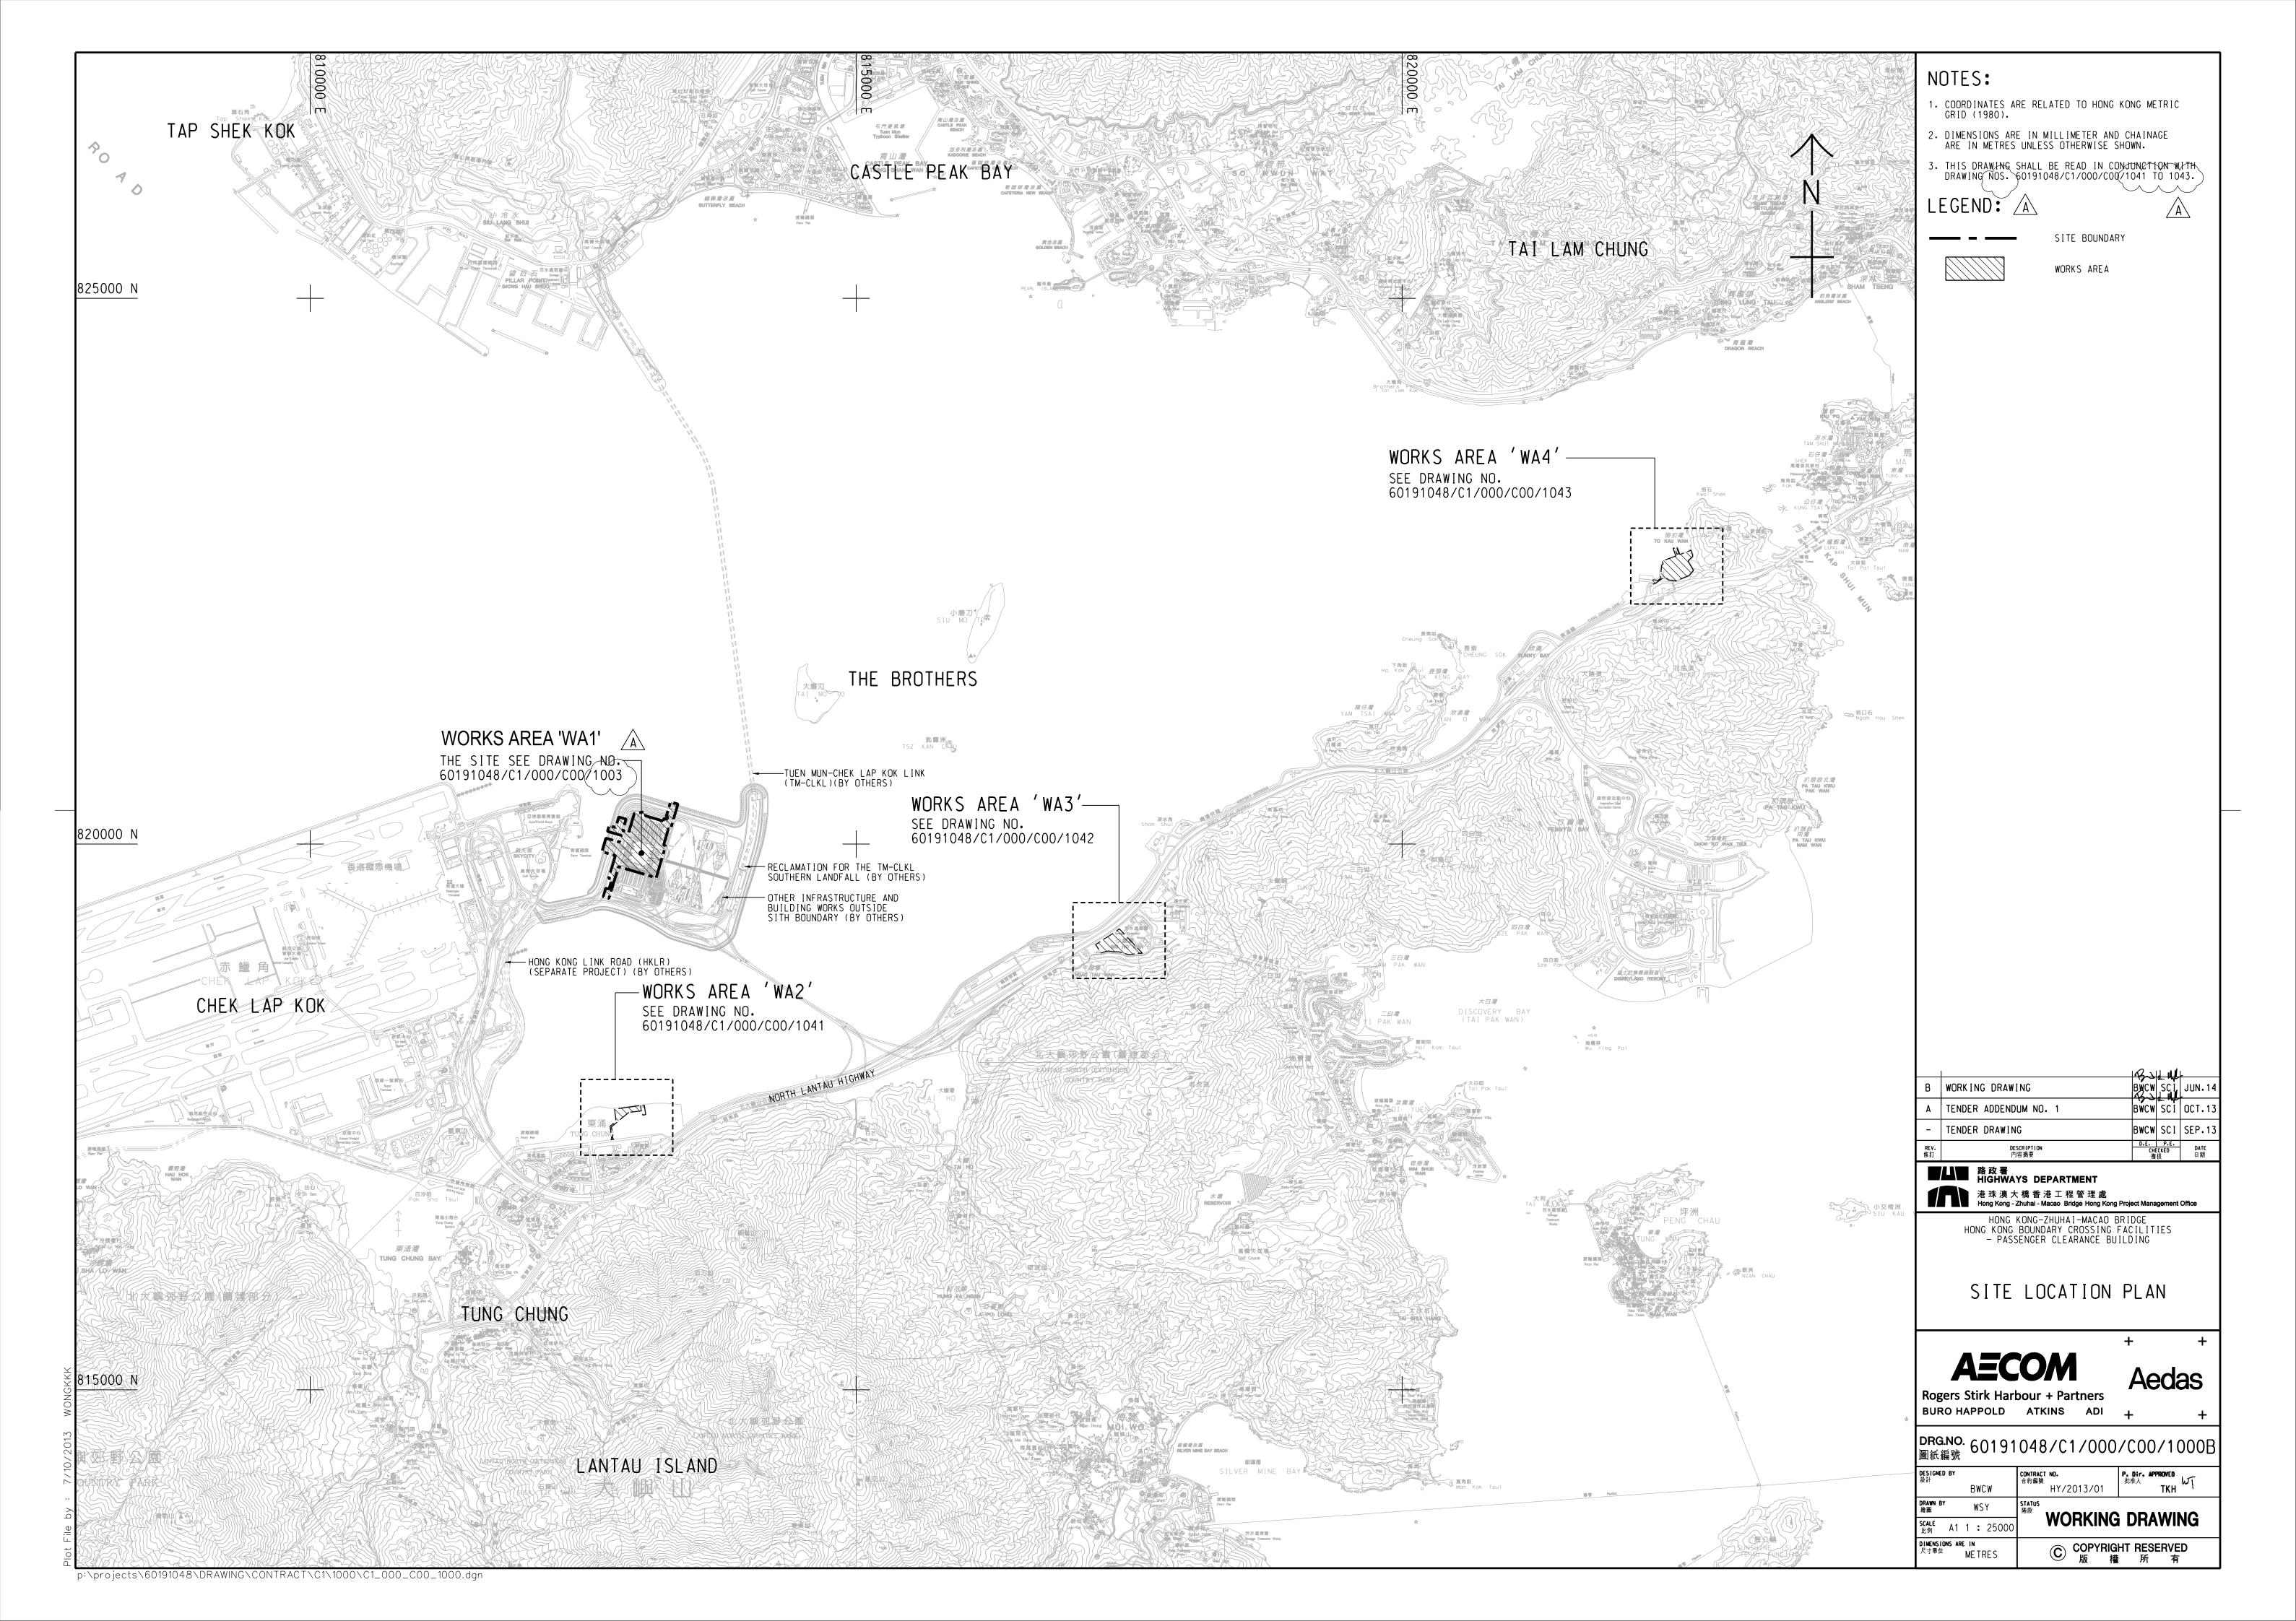

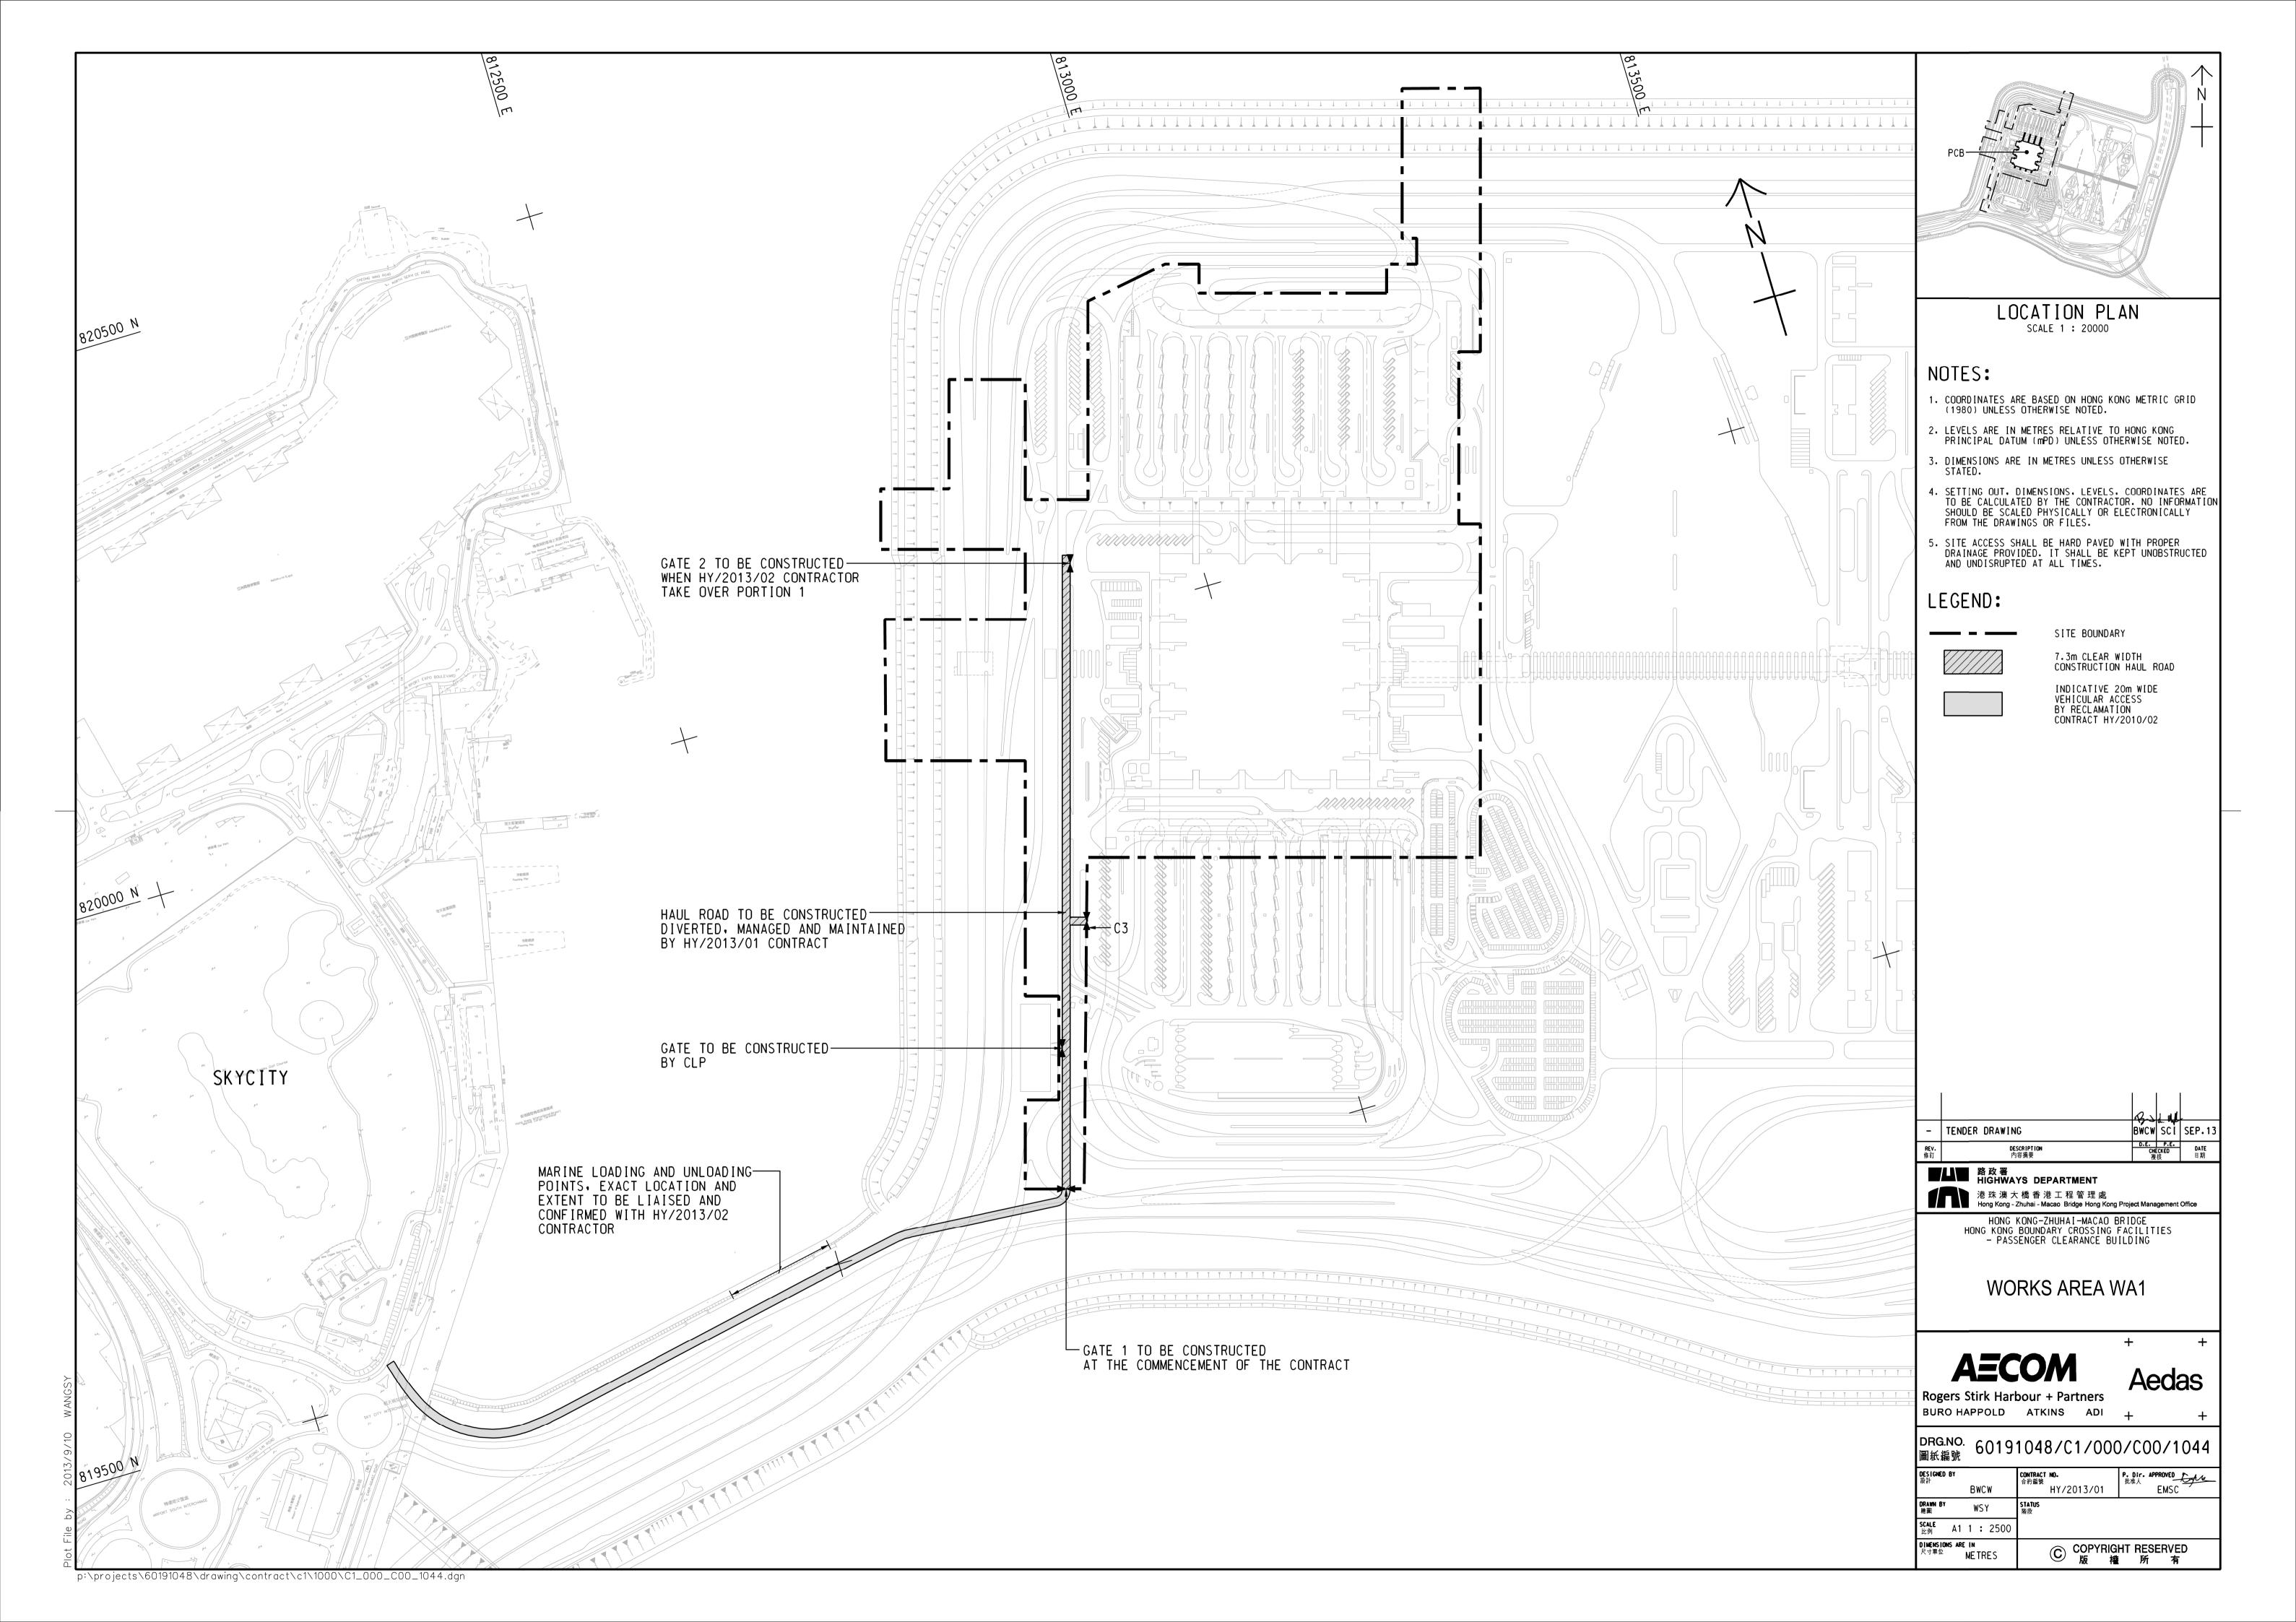

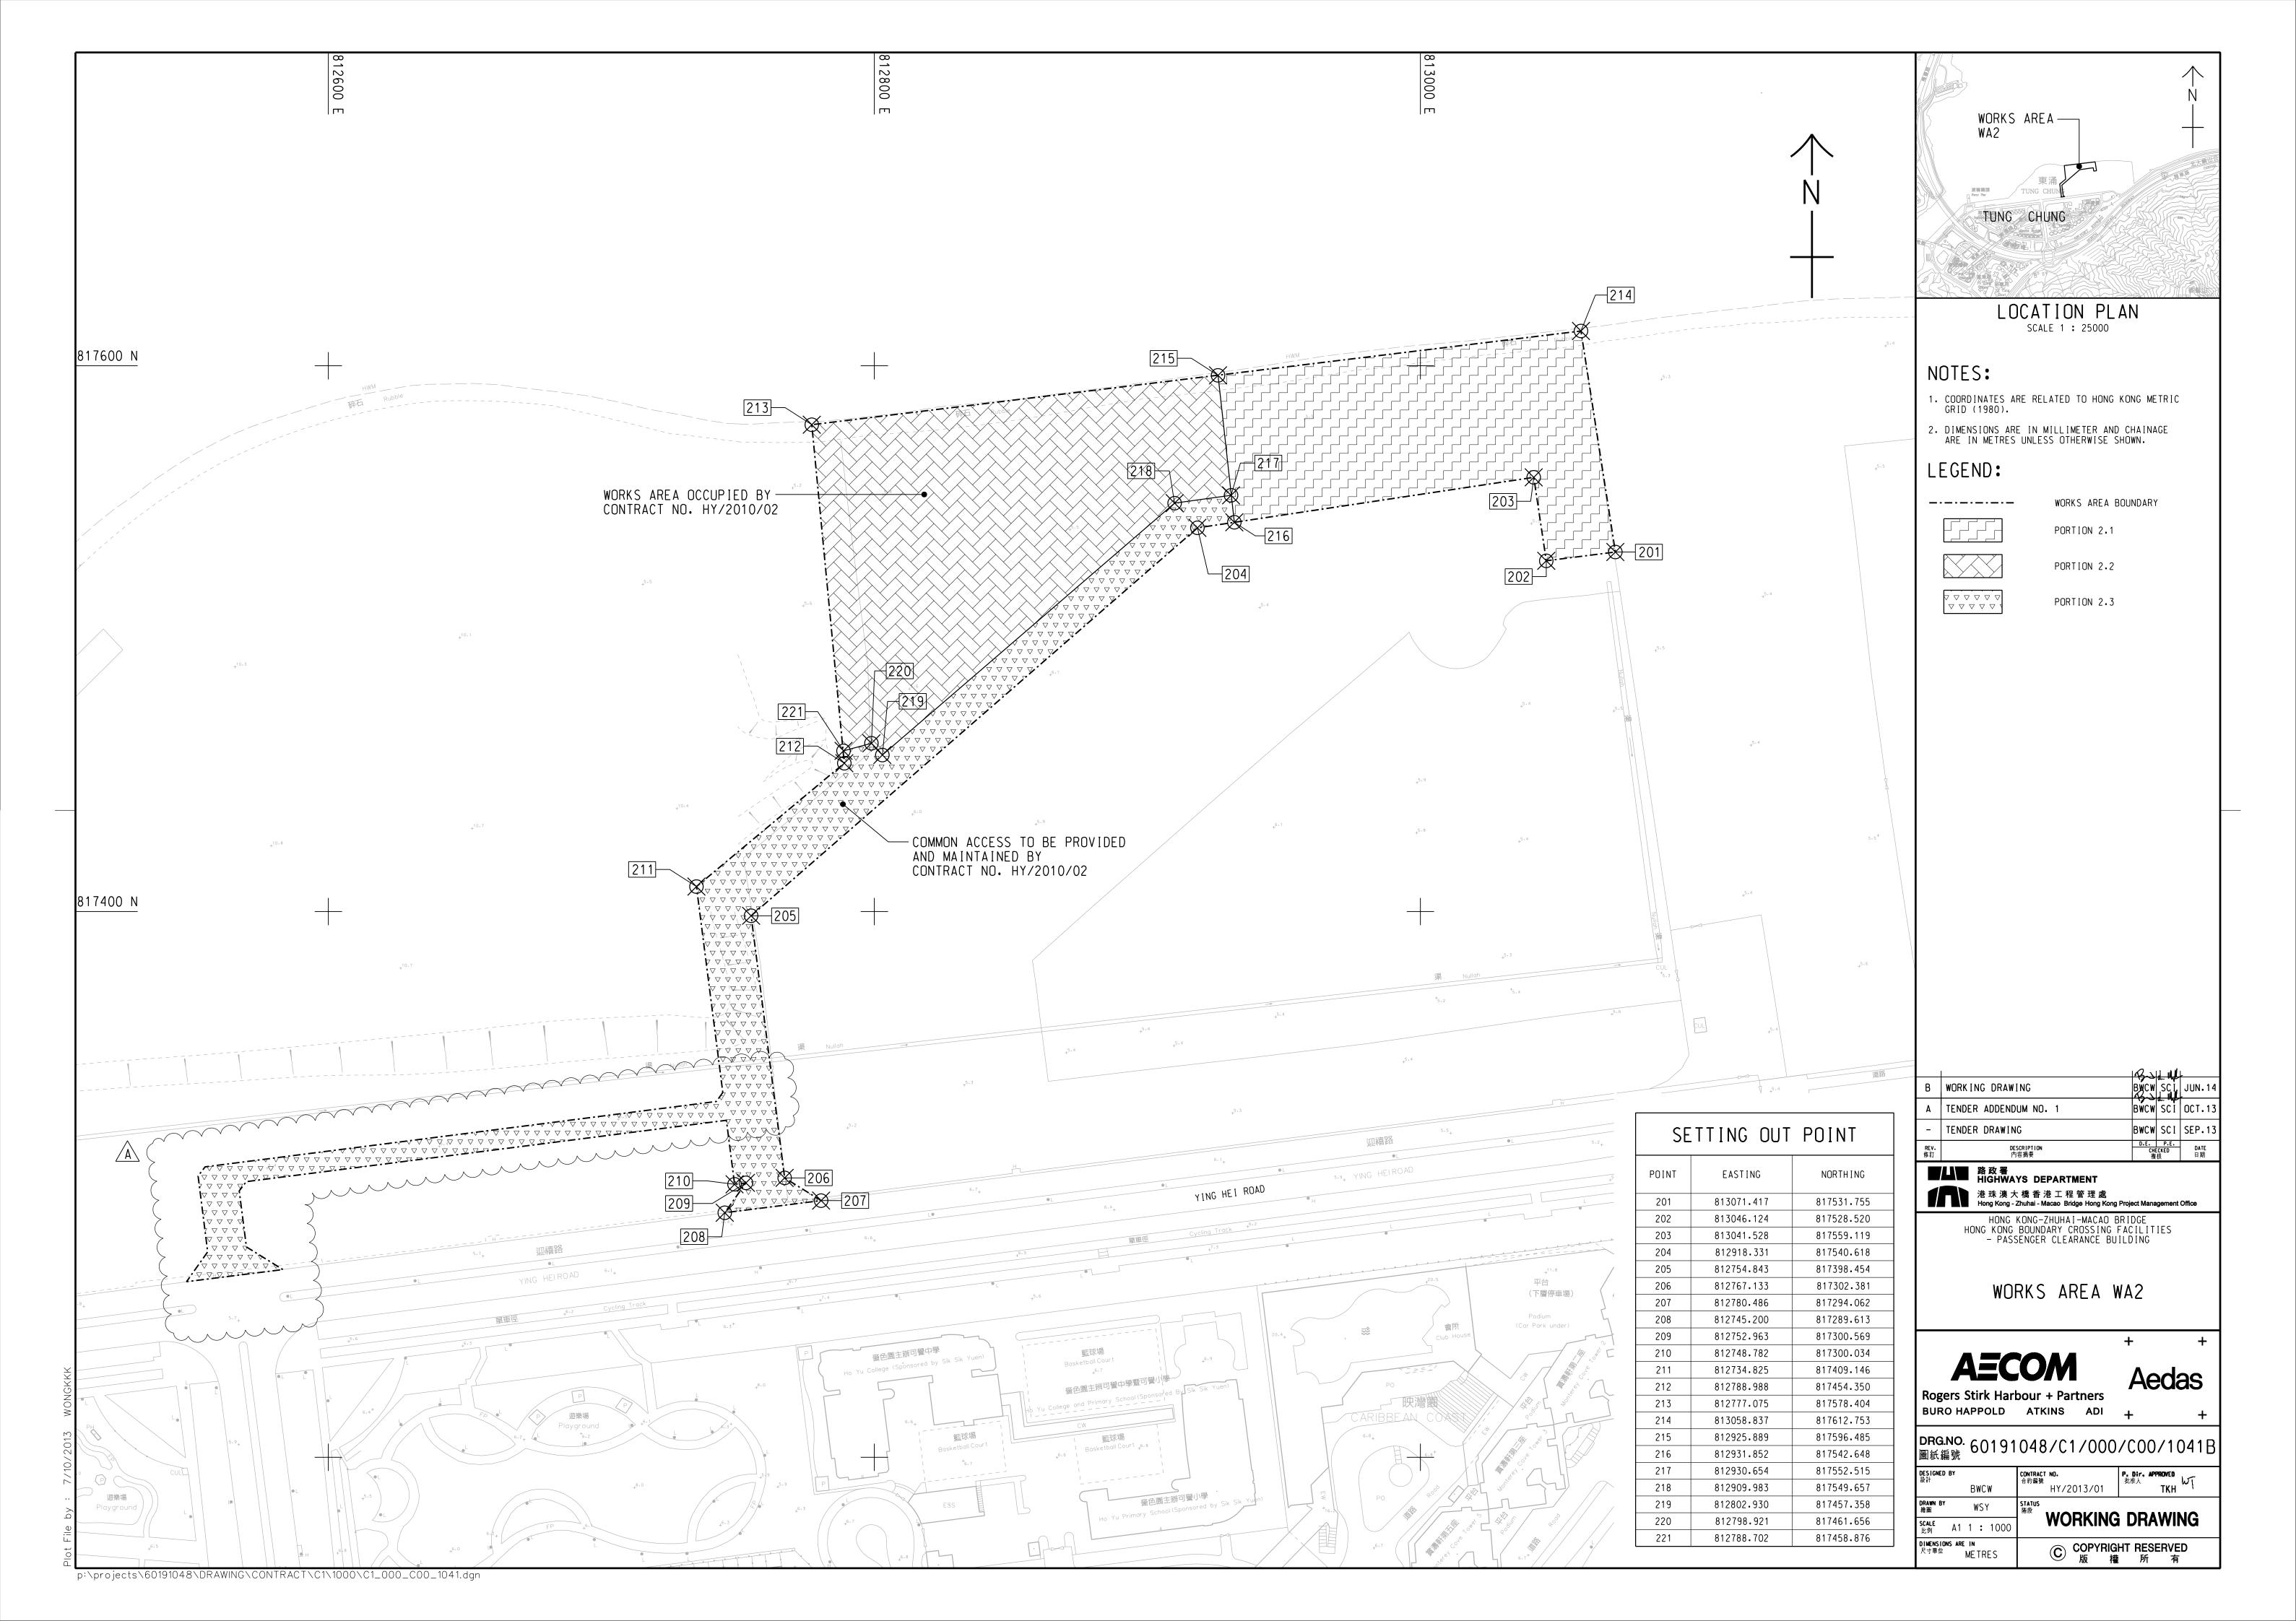

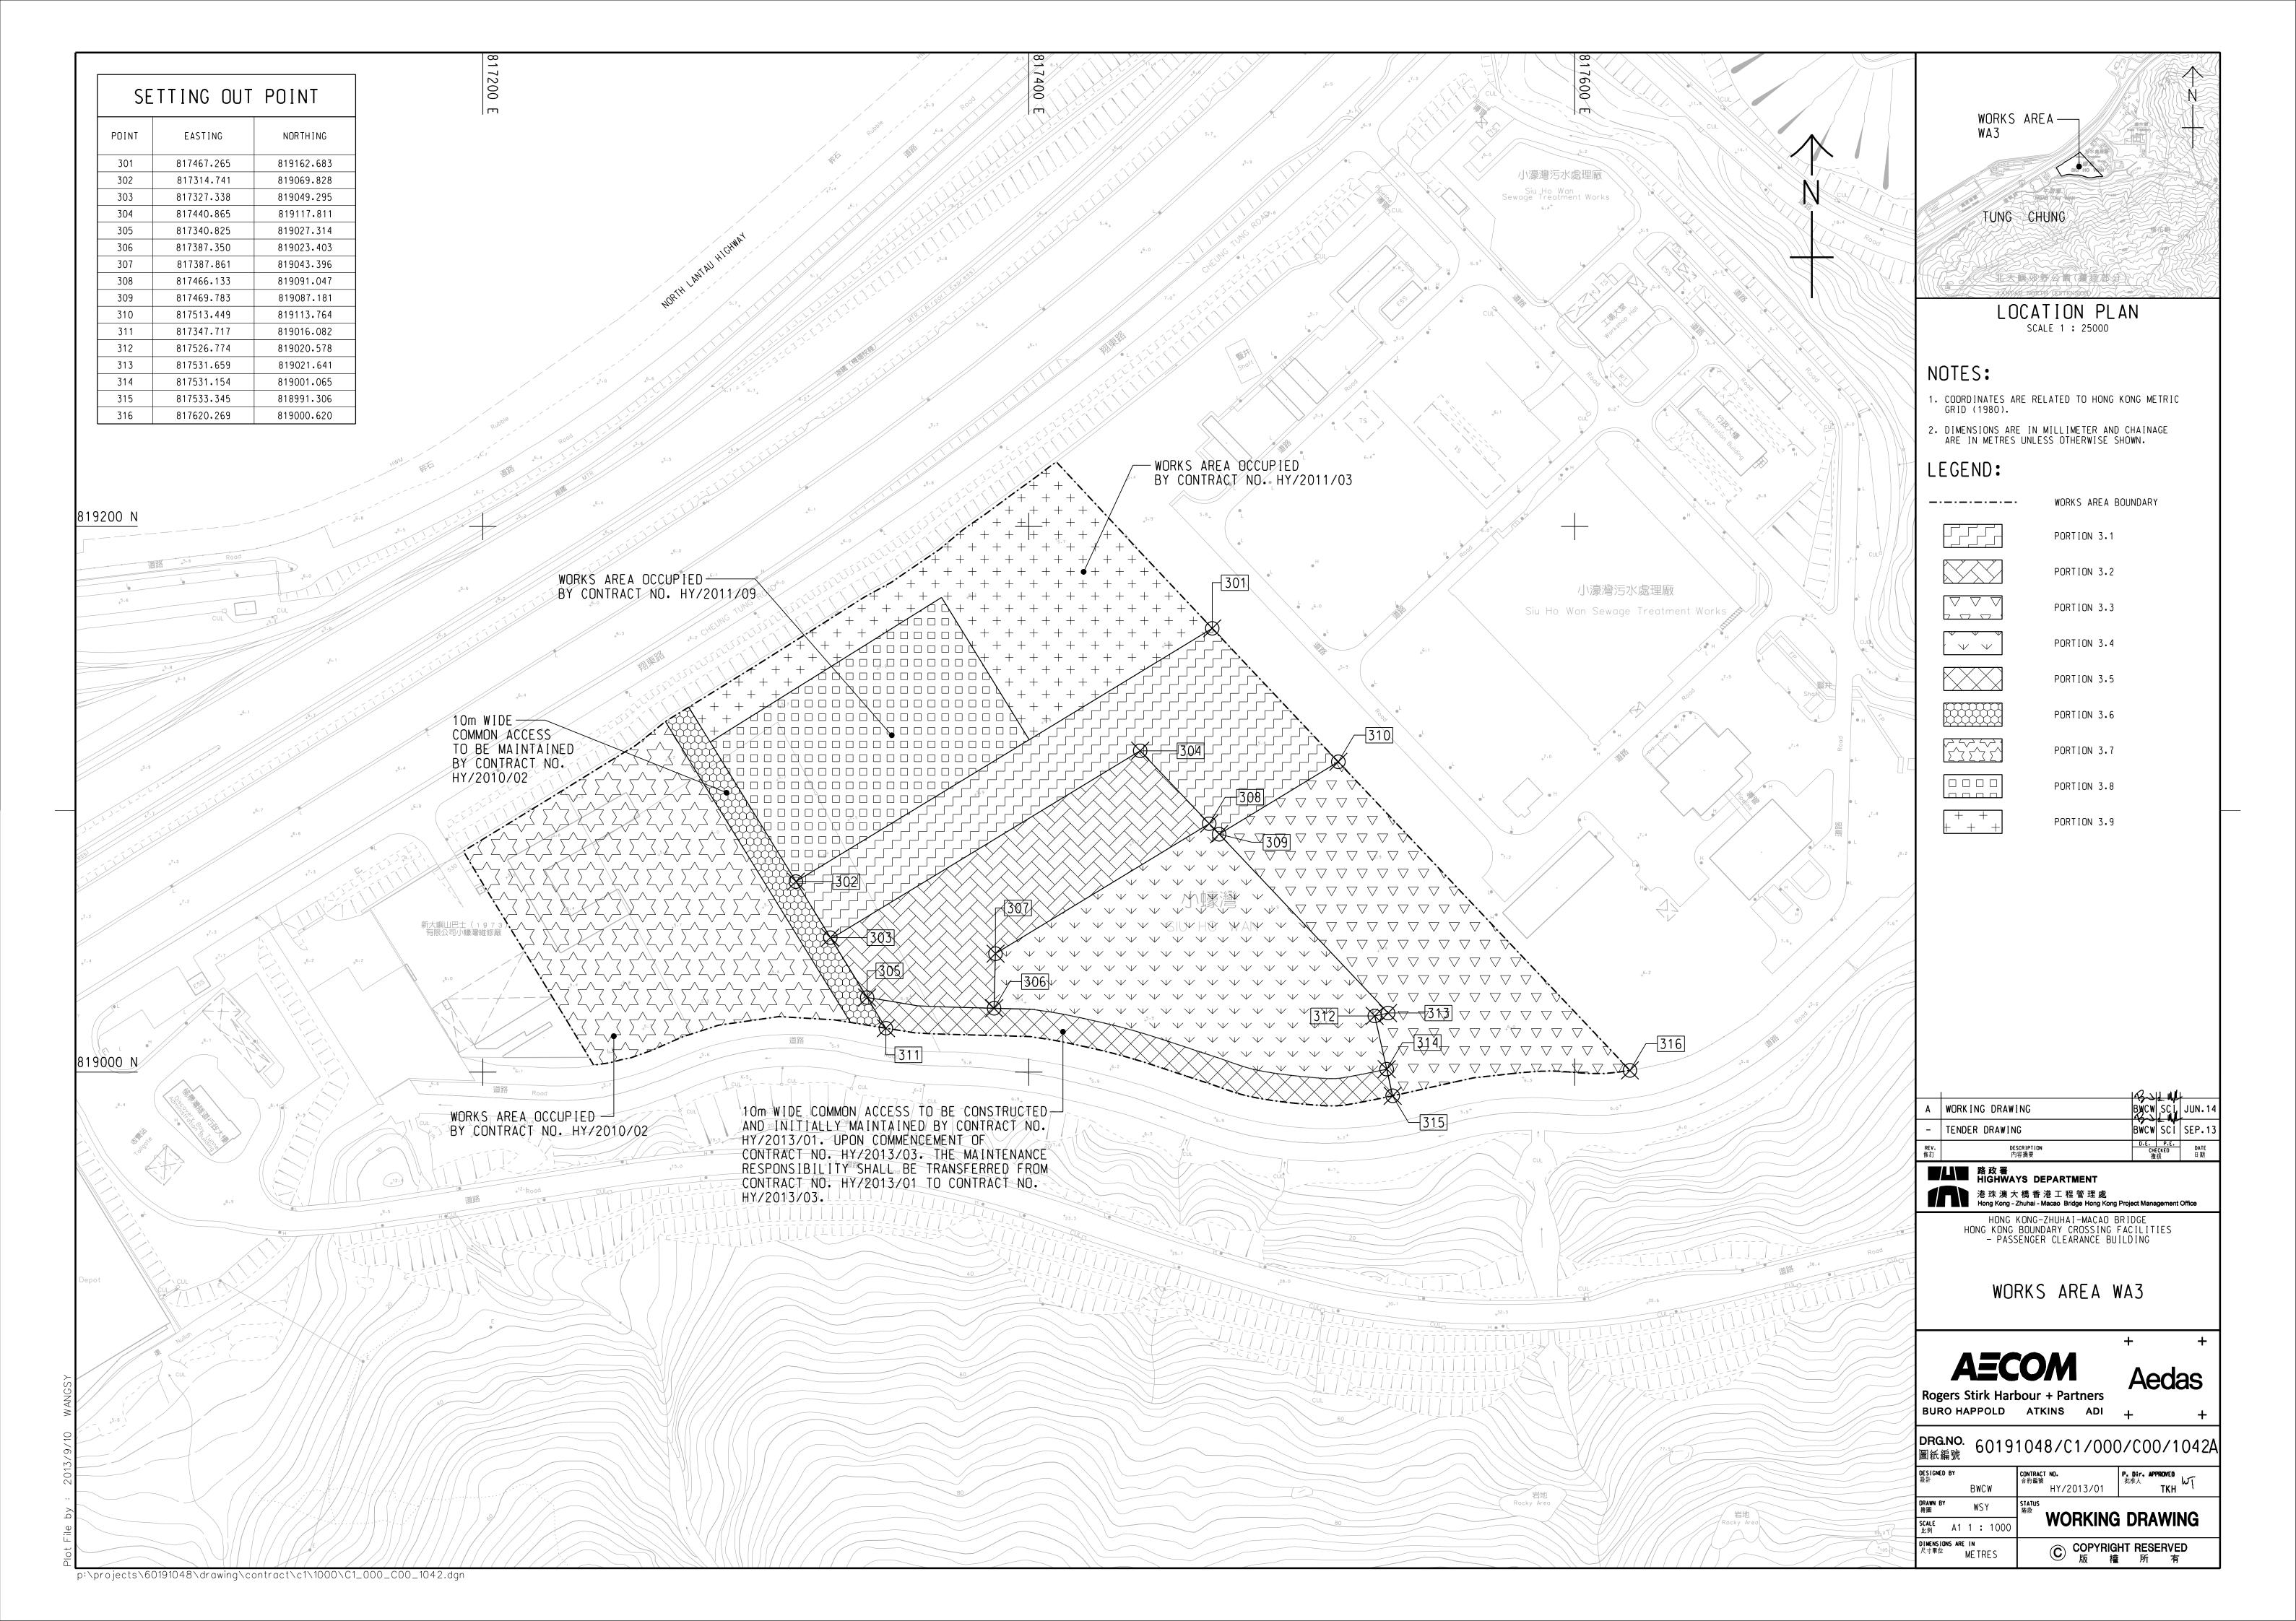

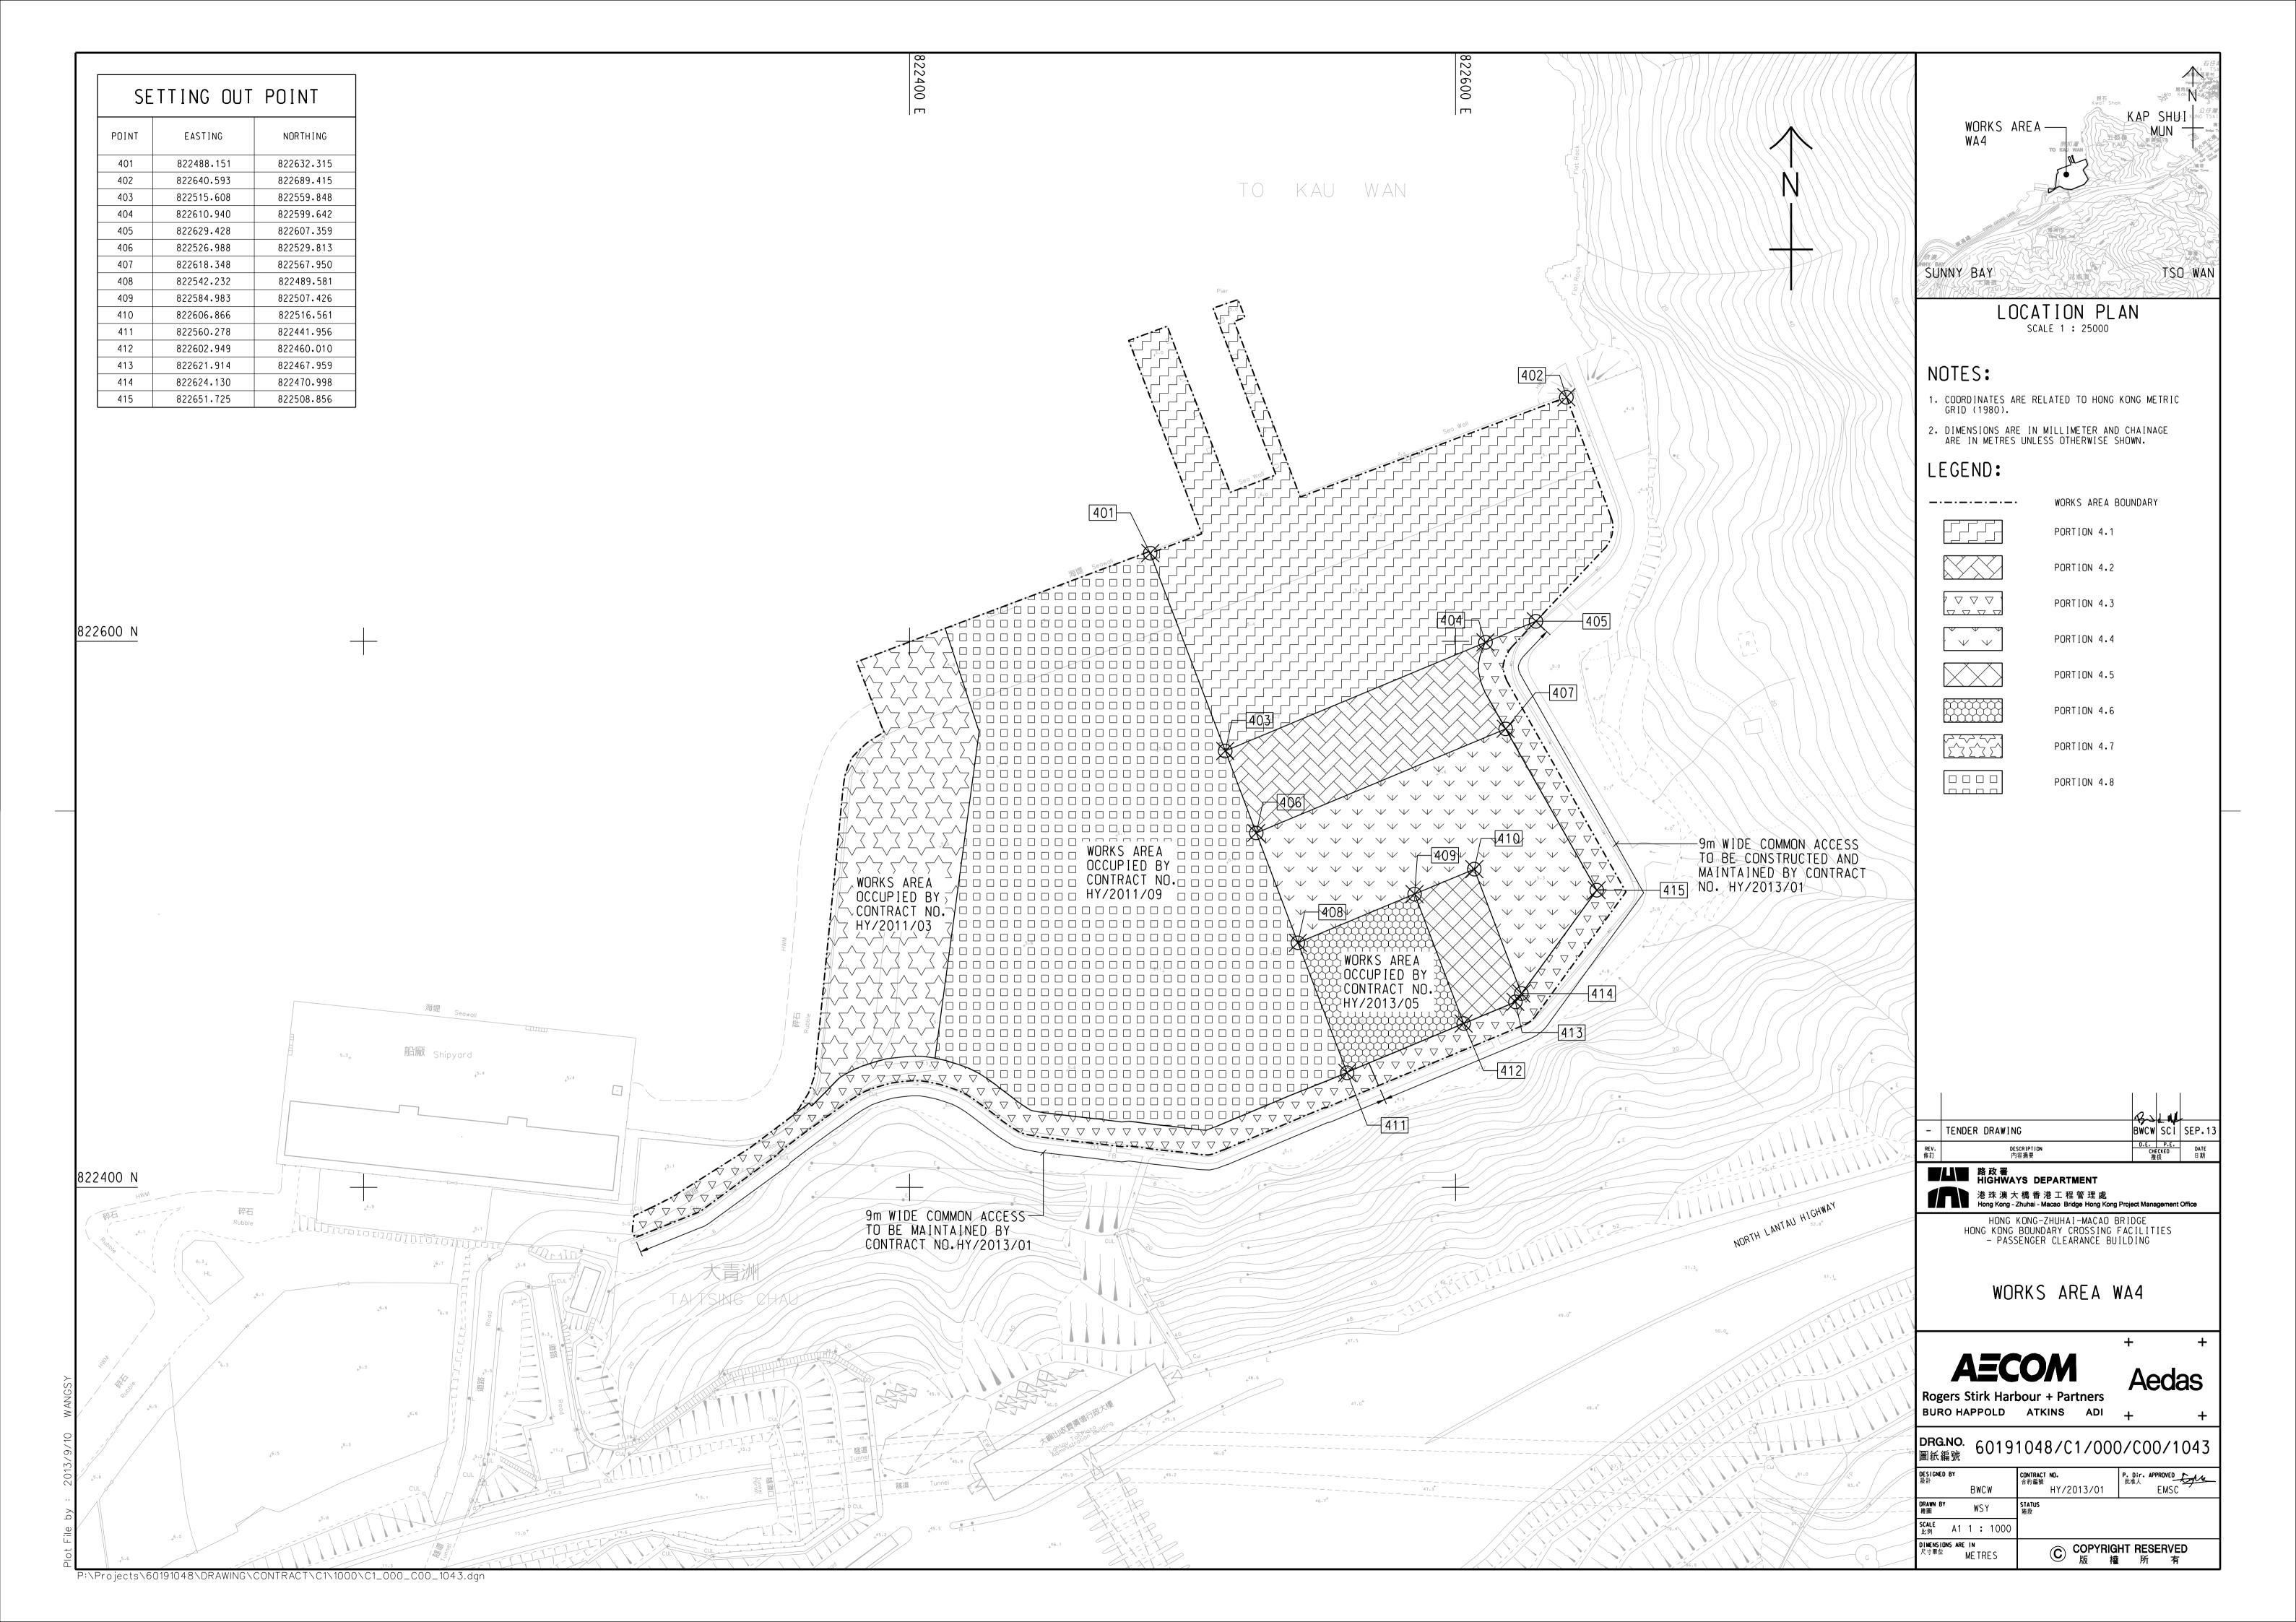




APPENDIX B

Project Organization for Environmental Works



Project Organisation for Environmental Works

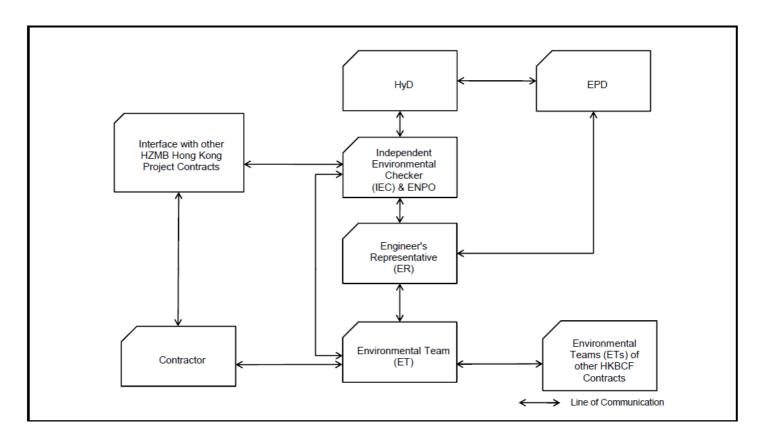





APPENDIX C

Construction Programme



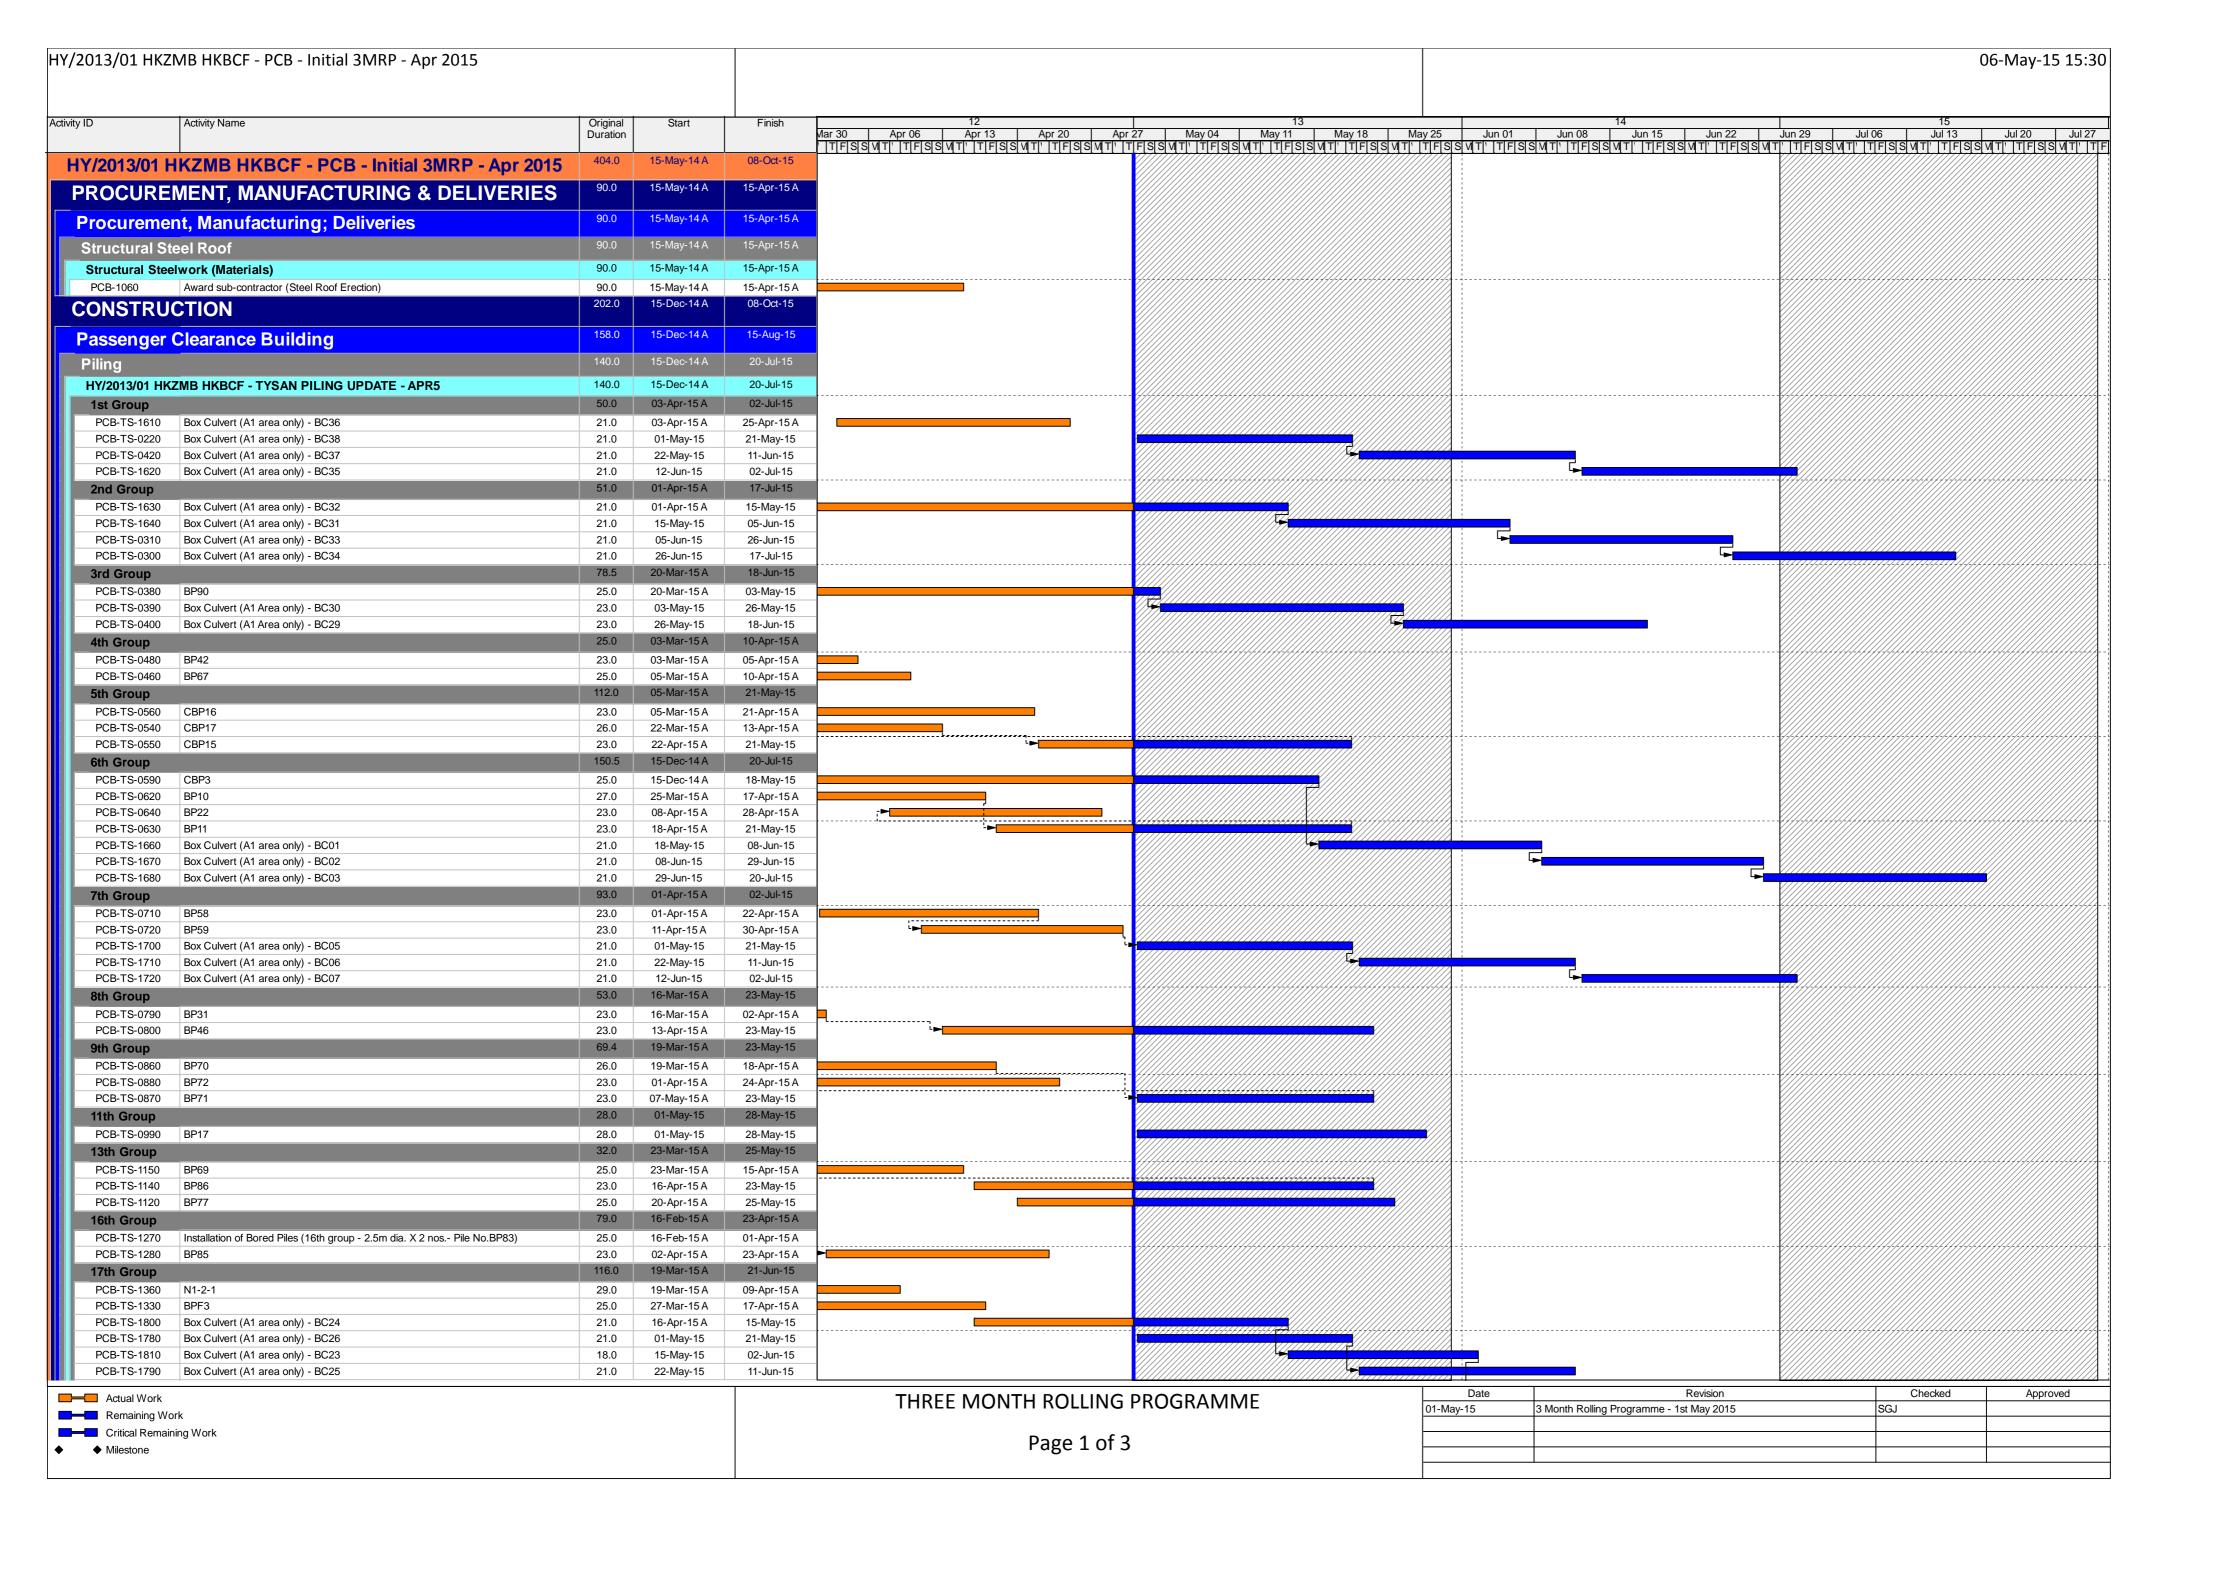

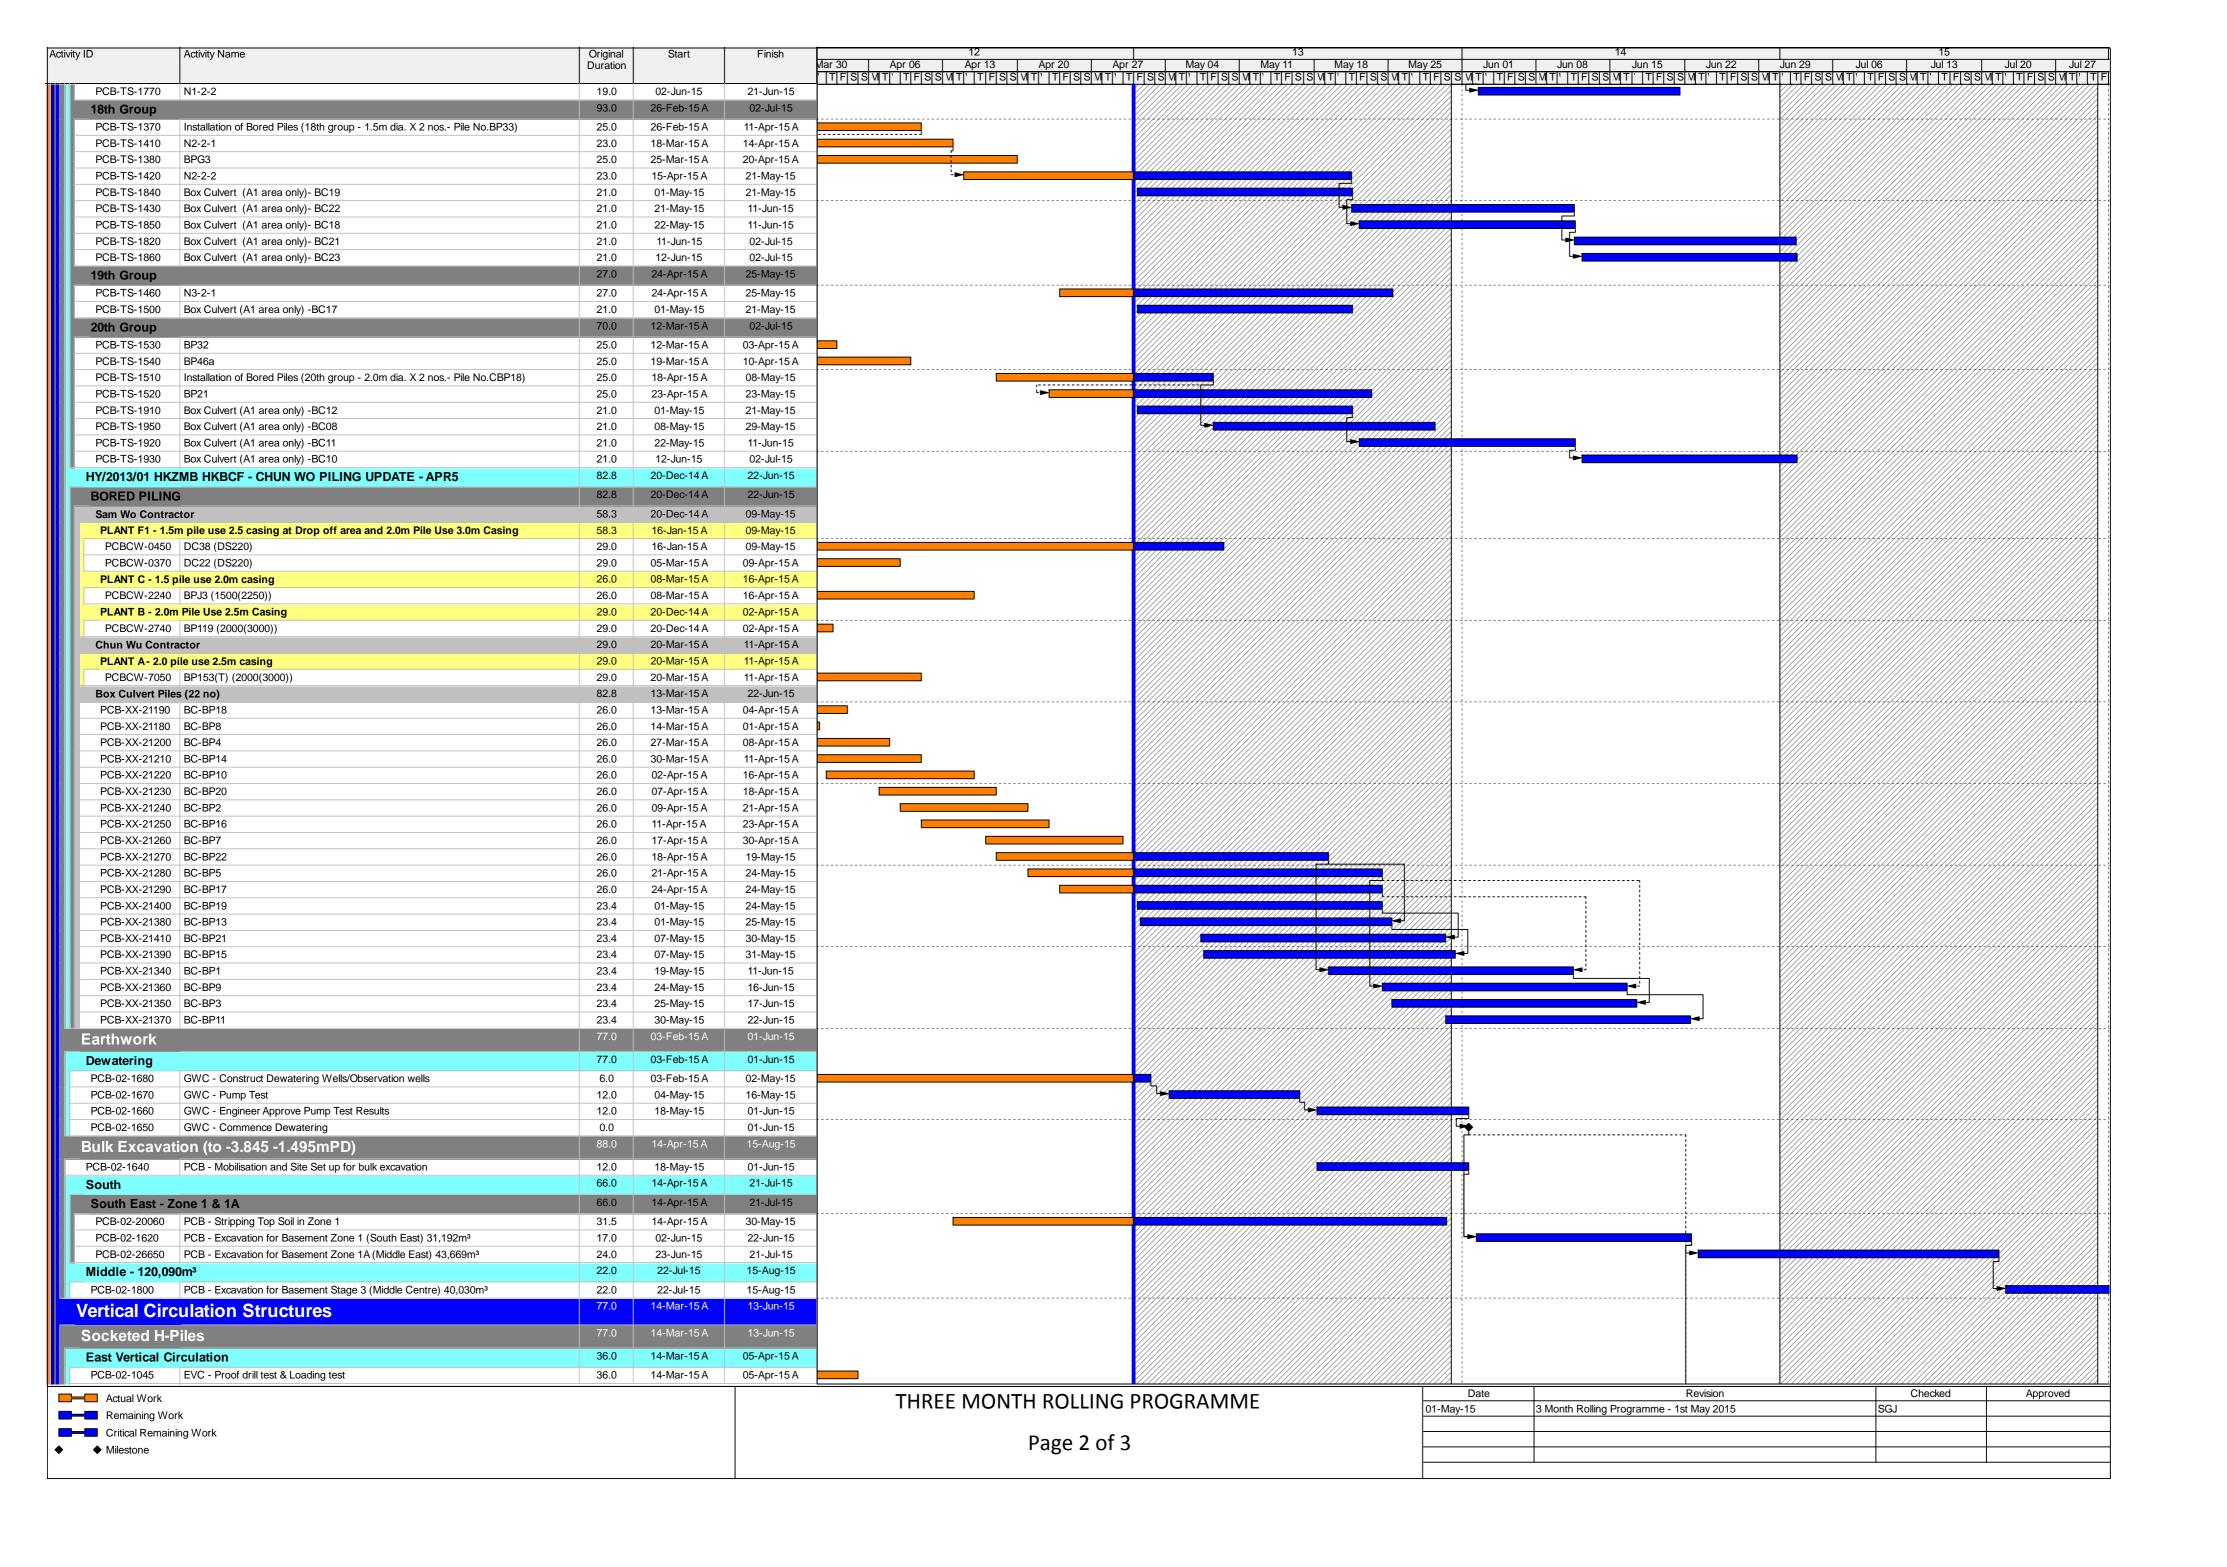

vity ID	Activity Name	Original Duration	Start	Finish	12 13 13 14 15 15 Mar 30 Apr 06 Apr 13 Apr 20 Apr 27 May 04 May 11 May 18 May 25 Jun 01 Jun 08 Jun 15 Jun 22 Jun 29 Jul 06 Jul 13 Jul 20
West Vertical	Circulation	71.5	17-Mar-15 A	13-Jun-15	
PCB-02-1005	WVC - Pre-bored H-pile (12nos) x 1Rig	36.0	17-Mar-15 A	07-May-15	
PCB-02-1015	WVC - Proof drill test & Loading test	36.0	02-May-15	13-Jun-15	
Southern I	Orop Off Area	132.0	14-Apr-15 A	08-Oct-15	
Gridline J - I	RC Works (5 Mega Columns)	16.0	15-Aug-15	02-Sep-15	
J5 (to +19.0m	PD)	8.0	15-Aug-15	24-Aug-15	
PCB-02-26460	Construct Pile Cap - J5	8.0	15-Aug-15	24-Aug-15	
J4 (to +19.0m		8.0	25-Aug-15	02-Sep-15	
	Construct Pile Cap - J4	8.0	25-Aug-15	02-Sep-15	
	RC Works (5 Mega Columns)	24.0	15-Aug-15	11-Sep-15	
K5 (to +19.0m		16.0	15-Aug-15	02-Sep-15	
	Construct Pile Cap (Gridline K) - K5	8.0	15-Aug-15	24-Aug-15	
	Construct Column Head (1st Lift) - K5	8.0	25-Aug-15	02-Sep-15	
K4 (to +19.0m	· · ·	8.0	25-Aug-15	02-Sep-15	
	Construct Pile Caps (Gridline K) - K4	8.0	25-Aug-15	02-Sep-15	
K3 (to +19.0m		8.0	03-Sep-15	11-Sep-15	
<u> </u>	Construct Pile Caps (Gridline K) - K3	8.0	03-Sep-15	11-Sep-15	
Excavation	Construct tile Caps (Challite N) - No	72.0	14-Apr-15 A	28-Jul-15	
_					
PCB-02-20070	DoA - EAST - Stripping Top Soil in DoA East	32.0	14-Apr-15 A	30-May-15	
PCB-02-20080	DoA - EAST - Excavation and ELS for DoA East Pile Caps (21 No)	30.0	23-Jun-15	28-Jul-15	
RC Works		78.0	08-Jul-15	08-Oct-15	
PCB-16-230	DoA - EAST - Break down and make good piles to cut off level (+2.075mPD) (21 no)	33.0	08-Jul-15	14-Aug-15	
PCB-16-250	DoA - EAST - Construct Pile Caps (21 No) (to +4.0mPD)	66.0	22-Jul-15	08-Oct-15	
Common l	Jtilities Enclosure	75.0	17-Mar-15 A	13-Jun-15	
Piling		75.0	17-Mar-15 A	13-Jun-15	
PCB-9A-1820	CUE - Prebored socket H-piles (5 nos)	16.0	17-Mar-15 A	05-Apr-15 A	
PCB-9A-1830	CUE - Prebored socket H-piles (5 nos)	16.0	06-Apr-15 A	20-Apr-15 A	
PCB-9A-1840	CUE - Prebored socket H-piles (6 nos)	16.0	20-Apr-15 A	27-Apr-15 A	
PCB-9A-120	CUE - Proof drilling & loading test	36.0	02-May-15	13-Jun-15	

	Actual Work
	Remaining Work
	Critical Remaining Work
* *	Milestone

Date	Revision	Checked	Approved
01-May-15	3 Month Rolling Programme - 1st May 2015	SGJ	
	•		



APPENDIX D

Event and Action Plan



Event/Action Plan for Air Quality

EVENT	ACTION						
	ET	IEC	ER	CONTRACTOR			
ACTION LEVEL							
Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily.	Check monitoring data submitted by ET; Check Contractor's working method.	Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.			
Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurement s to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 			

	EVENT	ACTION					
		ET	IEC	ER	CONTRACTOR		
L:	Exceedance for one sample	1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform ER, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of	Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 		
2.	Exceedance	Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 1. Notify IEC, ER,	remedial measures; 5. Supervise implementation of remedial measures. 1. Discuss amongst	Confirm receipt of	Take immediate		
	for two or more consecutive samples	Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring.	ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; 3. Supervise the implementation of remedial measures.	notification of failure in writing; 2. Notify Contractor; 3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.		

Event / Action Plan for Construction Noise Monitoring

EVENT	ACTION					
	ET	ET IEC ER		CONTRACTOR		
Action Level	exceedance and propose remedial measures; 3. Report the results of investigation to the		notification of failure in writing; 2. Notify Contractor;	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.		
Limit Level	 Inform IEC, ER, EPD and Contractor; Identify source; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, ER and EPD the causes and actions taken for the exceedances; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated. 		



APPENDIX E

Implementation Schedule for Environmental Mitigation Measures (EMIS)



Environmental Mitigation Implementation Schedule – Hong Kong Boundary Crossing Facilities (Superstructures and Infrastructures)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Air Quality	/						
S5.5.6.1	A1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500 µgm ⁻³ and 260 µgm ⁻³ , respectively)
S5.5.6.2	A2	 2) Proper watering of exposed spoil should be undertaken throughout the construction phase: Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; A stockpile of dusty material should not be extend beyond the pedestrian barriers, fencing or traffic cones. The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle; Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500 µgm ⁻³ and 260 µgm ³ , respectively)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S5.5.6.2	A2	 When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period; The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously; Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; Where a scaffolding is erected around the perimeter of a building under construction, effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding; Any skip hoist for material transport should be totally enclosed by impervious sheeting; Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500 µgm³ and 260 µgm³, respectively)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
\$5.5.6.2	A2	 Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system; and Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500 µgm ⁻³ and 260 µgm ⁻³ , respectively)
S5.5.6.3	A3	The Contractor should undertake proper watering on all exposed spoil (with at least 8 times per day) throughout the construction phase.	Control construction dust	Contractor	All construction sites	Construction stage	To control the dust impact
S5.5.6.4	A4	Engineer to incorporate the controlled measures into the Particular Specification (PS) for the civil work. The PS should also draw the contractor's attention to the relevant latest Practice Notes issued by EPD.	Control construction dust	Engineer	All construction sites	Design Stage	Air Pollution Control (Construction Dust) Regulation
S5.5.6.4	A5	5) Implement regular dust monitoring under EM&A programme during the construction stage.	Monitor the 24 hr and 1hr TSP levels at the representative dust monitoring stations to ensure compliance with relevant criteria throughout the construction period.	Contractor	Selected representative dust monitoring station	Construction stage	• Air Pollution Control (Construction Dust) Regulation To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1- hr and 24hr TSP levels are 500 µgm ⁻³ and 260 µgm ⁻³ , respectively)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S5.5.7.1	A6	 The following mitigation measures should be adopted to prevent fugitive dust emissions for concrete batching plant: Loading, unloading, handling, transfer or storage of any dusty materials should be carried out in totally enclosed system; All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system to meet the emission limits for TSP; Vents for all silos and cement/pulverised fuel ash (PFA) weighing scale should be fitted with fabric filtering system; The materials which may generate airborne dusty emissions should be wetted by water spray system; All receiving hoppers should be enclosed on three sides up to 3m above unloading point; All conveyor transfer points should be totally enclosed; All access and route roads within the premises should be paved and wetted; and Vehicle cleaning facilities should be provided and used by all concrete trucks before leaving the premises to wash off any dust on the wheels and/or body. 	Monitor the 24 hr and 1hr TSP levels at the representative dust monitoring stations to ensure compliance with relevant criteria throughout the construction period.	Contractor	Selected representative dust monitoring station	Construction stage	• Air Pollution Control (Construction Dust) Regulation • To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1- hr and 24hr TSP levels are 500 µgm³ and 260 µgm³, respectively)
S5.5.2.7	A7	The following mitigation measures should be adopted to prevent fugitive dust emissions at barging point: All road surface within the barging facilities will be paved; Dust enclosures will be provided for the loading ramp; Vehicles will be required to pass through designated wheels wash facilities; and Continuous water spray at the loading points.	Control construction dust	Contractor	All construction sites	Construction stage	Air Pollution Control (Construction Dust) Regulation

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		e (Air borne)	<u>, </u>				T-
S6.4.10	N1	 1) Use of good site practices to limit noise emissions by considering the following: only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; mobile plant should be sited as far away from NSRs as possible and practicable; material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. 	Control construction airborne noise by means of good site practices	Contractor	All construction sites	Construction stage	Noise Control Ordinance
S6.4.11	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of the hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening.	Contractor	All construction sites	Construction stage	Noise Control Ordinance Annex 5, TM-EIA
S6.4.12	N3	3) Install movable noise barriers (typically density @14kg/m²), acoustic mat or full enclosure close to noisy plants including air compressor, generators, saw. Output Description:	Screen the noisy plant items to be used at all construction sites	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	Noise Control Ordinance Annex 5, TM-EIA T5dB(A) for residential premises The movable barrier should achieve at least 5dB(A) and the full enclosure should be designed to achieve 10dB(A)

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S6.4.13	N4	4) Select "Quiet plants" which comply with the BS 5228 Part 1 or TM standards.	Reduce the noise levels of plant items	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	Noise Control Ordinance & its TM Annex 5, TM-EIA
S6.4.14	N5	5) Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	Noise Control Ordinance Annex 5, TM-EIA
	N6	6) Implement a noise monitoring under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected representative noise monitoring station	Construction stage	Noise Control Ordinance Annex 5, TM-EIA 75dB(A) for residential premises
Sediment							
S7.3	S1	The requirements as recommended in ETWB TC 34/2002 Management of Dredged/Excavated Sediment shall be included in the Particular Specification as appropriate.	Develop sediment disposal arrangement	Engineer	All construction sites	Design stage	Waste Disposal Ordinance ETWBTC 34/2002

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Waste Mai	nagement	(Construction Waste)					
S8.3.8	WM1	 Construction and Demolition Material The following mitigation measures should be implemented in handling the waste: Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'Selective Demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and Implement an enhanced W aste Management Plan similar to ETW BTC (W orks) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. In addition, disposal of the C&D materials onto any sensitive locations such as agricultural lands, etc. should be avoided. The Contractor shall propose the final disposal sites to the Project 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land (Miscellaneous Provisions) Ordinance Waste Disposal Ordinance ETWB TC 19/2005

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S8.3.9- S8.3.11	WM2	Standard formwork or pre-fabrication should be used as far as practicable in order to minimise the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage. The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land (Miscellaneous Provisions) Ordinance Waste Disposal Ordinance ETWB TC 19/2005
S8.2.12- S8.3.15	WM3	 Chemical Waste Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; have a capacity of less than 450 liters unless the specification has been approved by the EPD; and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation. The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste; enclosed on at least 3 sides; have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20 % of the total volume of waste stored in that area, whichever is the greatest; have adequate ventilation; covered to prevent rainfall entering; and arranged so that incompatible materials are adequately separated. 	Control the chemical waste and ensure proper storage, handling and disposal.	Contractor	All construction sites	Construction stage	Waste Disposal (Chemical Waste) General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		Disposal of chemical waste should be via a licensed waste collector; be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers; or be to a reuser of the waste, under approval from the EPD.					
S8.3.16	WM4	Sewage Adequate numbers of portable toilets should be provided for the workers. The portable toilets should be maintained in a state, which will not deter the workers from utilizing these portable toilets. Night soil should be collected by licensed collectors regularly.	Proper handling of sewage from worker to avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Dispos al Ordinance
S8.3.17	WM5	 General Refuse General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes. A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminium cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible. Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. In addition, waste separation facilities for paper, aluminum cans, plastic bottles etc., should be provided. Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including reduction, reuse and recycling of wastes. 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Dispos al Ordinance

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Water Qua		struction Phase)					
S9.11.1.7	W2	Land Works General construction activities on land should also be governed by standard good working practice. Specific measures to be written into the works contracts should include:	To control construction water quality	Contractor	Land-based works areas	Construction stage	TM-EIAO
		wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters;					
		sewage effluent and discharges from on-site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the W PCO or collected for disposal offsite. The use of soakaways shall be avoided;					
		storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks;					
		silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including specifically at the onset of and after each rainstorm;					
		temporary access roads should be surfaced with crushed stone or gravel;					
		rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;					
		measures should be taken to prevent the washout of construction materials, soil, silt or debris into any drainage system;					
		open stockpiles of construction materials (e.g. aggregates and sand) on site should be covered with tarpaulin or similar fabric during rainstorms;					
		manholes (including any newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers;					
		discharges of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system;					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S9.11.1.7	W2	all vehicles and plant should be cleaned before they leave the construction site to ensure that no earth, mud or debris is deposited by them on roads. A wheel washing bay should be provided at every site exit;	To control construction water quality	Contractor	Land-based works areas	Construction stage	TM-EIAO
		wheel wash overflow shall be directed to silt removal facilities before being discharged to the storm drain;					
		the section of construction road between the wheel washing bay and the public road should be surfaced with crushed stone or coarse gravel;					
		wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects;					
		vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the WPCO or collected for off site disposal;					
		the contractors shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately;					
		waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance;					
		 all fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank; and 					
		surface run-off from bunded areas should pass through oil/grease traps prior to discharge to the stormwater system.					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Ecology (Construction	Phase)					
S10.7	E4	Watering to reduce dust generation; prevention of siltation of freshwater habitats; Site runoff should be desilted, to reduce the potential for suspended sediments, organics and other contaminants to enter streams and standing freshwater	Land-based works areas	Contractor	Land-based works areas	During construction	TM-Water
S10.7	E5	Good site practices, including strictly following the permitted works hours, using quieter machines where practicable, and avoiding excessive lightings during night time		Contractor	Land-based works areas	During construction	
S10.7	E8	 Control vessel speed Skipper training Predefined and regular routes for working vessels; avoid Brother Islands. 	Minimise marine traffic disturbance on dolphins	Contractor	Marine traffic	During construction	
Fisheries							1
S11.7	F4	Maritime Oil Spill Response Plan (MOSRP); Contingency plan.	Minimise impacts on marine water quality impacts	Marine Department	НКВСГ	During operation	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Landscap	e & Visua	l (Detailed Design Phase)					
S14.3.3.1	LV1	General design measures include: Roadside planting and planting along the edge of the HKBCF Island is proposed; Transplanting of mature trees in good health and amenity value where appropriate and reinstatement of areas disturbed during construction by compensatory hydro-seeding and planting; Protection measures for the trees to be retained during construction activities; Optimizing the sizes and spacing of the bridge columns; Fine-tuning the location of the bridge columns to avoid visually-sensitive locations; Maximizing new tree, shrub and other vegetation planting to compensate tree felled and vegetation removed; Providing planting area around peripheral of HKBCF for tree planting screening effect; Providing salt-tolerant native trees along the planter strip at affected seawall and newly reclaimed coastline; For HKBCF, providing aesthetic architectural design on the related buildings (e.g. similar materials for PCB building facade to Airport buildings and so on), and the related infrastructure (e.g. parapet planting and transparent cover for elevated footbridges) to provide harmonious atmosphere of the HKBCF; and Fine-tuning the sizes of the structural members to minimize the bulkiness of buildings and adjustment of building arrangement to minimise disturbance to surrounding vegetation in the HKBCF.	Minimise visual & landsc ape impact	Detailed designer	HKBCF	Design Stage	

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Landscap	e & Visua	l (Construction Phase)					
S14.3.3.3		Mitigate both Landscape and Visual Impacts G1. Grass-hydroseed bare soil surface and stock pile areas. G2. Add planting strip and automatic irrigation system if appropriate at some portions of bridge footbridge to screen bridge and traffic. G3. Not applicable as this is for HKLR. G4. For HKBCF, providing aesthetic architectural design on the related buildings (e.g. similar materials for PCB building facade to Airport buildings, roof planting and subtle materials for other facilities buildings and so on), and the related infrastructure (e.g. parapet planting and transparent cover for elevated footbridges) to provide harmonious atmosphere of the HKBCF G5. Vegetation reinstatement and upgrading to disturbed areas G6. Maximizing new tree shrub and other vegetation planting to compensate tree felled and vegetation removed G7. Providing planting area around peripheral of HKBCF for tree planting screening effect; G8. Plant salt-tolerant native and shrubs etc along the planter strip at affected seawall. G9. Reserve of loose natural granite rocks for re-use. Provide new coastline to adopt "natural-look" by means of using armour rocks in the form of natural rock materials and planting strip area	Minimise visual & landscape impact	Contractor	HKBCF	Construction stage	
S14.3.3.3	LV3	accommodating screen buffer to enchance "natural-look" of the new coastline. Mitigate Visual Impacts V1.Minimize time for construction activities during construction period. V2.Provide screen hoarding at the portion of the project site / works areas / storage areas near VSRs who have close low-level views to the Project during HKBCF construction.					

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
EM&A							
S15.2.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	Control EM&A Performance	Project Proponent	All construction sites	Construction stage	• EIAO Guidance Note No.4/2002 • TM-EIAO
S15.5 - S15.6	EM2	 An Environmental Team needs to be employed as per the EM&A Manual. Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures. An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with. 	Perform environmental monitoring & auditing	Contractor	All construction sites	Construction stage	• EIAO Guidance Note No.4/2002 • TM-EIAO



APPENDIX F

Site Audit Findings and Corrective Actions





Contract No. HY/2013/01
Hong Kong-Zhuhai-Macao Bridge
Hong Kong Boundary Crossing Facilities – Passenger Clearance Building
3rd Quarterly EM&A Report

Appendix F – Site Audit Findings and Corrective Actions

- 1.1.1 Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. During the reporting period, thirteen site inspections were carried out on 1, 8, 15, 22 and 29 April 2015, 6, 13, 20 and 27 May 2015 and 3, 10, 17, 24 and 30 June 2015.
- 1.1.2 Particular observations during the site inspections are described below.

1 April 2015

- (a) Empty chemical containers were accumulated on the ground. The empty chemical containers were removed. This observation was found on 25 March 2015 and closed on 1 April 2015.
- (b) The tarpaulin at the top of shelter for a grouting mixing unit was not tightened. The tarpaulin at the top of shelter for the grouting mixing unit was fixed. This observation was found on 1 April 2015 and closed on 8 April 2015.
- (c) No drip tray was provided for a chemical container. The chemical container was removed. This observation was found on 1 April 2015 and closed on 8 April 2015.

8 April 2015

(a) No particular environmental issue was recorded during the site inspection.

15 April 2015

(a) No drip tray was provided for a chemical drum near air compressor. A drip tray was provided for the chemical drum. This observation was found on 15 April 2015 and closed on 22 April 2015.

22 April 2015

- (a) No cover was provided for a stock of more than 20 bags of cement. A cover was provided for the cement bags. This observation was found on 22 April 2015 and closed on 29 April 2015.
- (b) A grouting area was not enclosed. The grouting mixing unit was sheltered on the top and three sides. This observation was found on 22 April 2015 and closed on 29 April 2015.
- (c) No drip tray was provided for a diesel drum. A drip tray was provided for the diesel drum. This observation was found on 22 April 2015 and closed on 29 April 2015.

29 April 2015

(a) Temporary stockpiles of untreated marine mud were not placed within the bund and tarpaulin was not provided at the bottom of the temporary storage area. The temporary stockpiles of untreated marine mud were removed. This observation was found on 29 April 2015 and closed on 6 May 2015.



Contract No. HY/2013/01

Hong Kong-Zhuhai-Macao Bridge
Hong Kong Boundary Crossing Facilities – Passenger Clearance Building
3rd Quarterly EM&A Report

6 May 2015

- (a) Food waste was scattered in a refuse collection skip. The food waste was placed inside plastic bags before disposing of in the refuse collection skip. This observation was found on 6 May 2015 and closed on 13 May 2015.
- (b) Chemical containers were place on the ground without drip trays. The chemical containers were removed. This observation was found on 6 May 2015 and closed on 13 May 2015.

13 May 2015

(a) A grouting mixing unit was not sheltered on the top. An enclosure (sheltered on the top and three sides) was provided for the grouting mixing unit. This observation was found on 13 May 2015 and closed on 20 May 2015.

20 May 2015

(a) No particular environmental issue was recorded during the site inspection.

27 May 2015

(a) Water accumulation was found inside a drip tray. The stagnant water was removed. This observation was found on 27 May 2015 and closed on 3 June 2015.

3 June 2015

- (a) Water accumulation was found inside drip trays near a water treatment facility. The drip trays were removed. No stagnant water was found near the water treatment facility. This observation was found on 3 June 2015 and closed on 10 June 2015.
- (b) A stockpile of more than 20 bags of cement was not covered. A cover was provided for the cement bags. This observation was found on 3 June 2015 and closed on 10 June 2015.

10 June 2015

(a) No drip tray was provided for chemical containers. The chemical containers were removed. This observation was found on 10 June 2015 and closed on 17 June 2015.

17 June 2015

(a) The stockpile of the cement was found to be partially covered. The stockpile of the cement was removed. This observation was found on 17 June 2015 and closed on 24 June 2015.

24 June 2015

(a) No drain plug was provided for a drip tray. The contaminated water inside the drip tray may drain off to the ground. A drain plug was provided for the drip tray. This observation was found on 24 June 2015 and closed on 30 June 2015.



Contract No. HY/2013/01
Hong Kong-Zhuhai-Macao Bridge
Hong Kong Boundary Crossing Facilities – Passenger Clearance Building
3rd Quarterly EM&A Report

(b) No drip trays were provided for chemicals. The chemicals were removed. This observation was found on 24 June 2015 and closed on 30 June 2015.

30 June 2015

(a) Chemicals were placed without drip tray. The Contractor is recommended to provide drip trays for the chemicals.

The Contractor has rectified most of the observations as identified during environmental site inspections during the reporting month. Follow-up actions for outstanding observations will be inspected during the next site inspections.



APPENDIX G

Waste Flow Table



Monthly Summary Waste Flow Table for 2015



Contract No.: HY/2013/01

	Actua	al Quantities	of Inert C&D	Materials G	enerated Mo	nthly	Actual (Quantities of	C&D Wastes	Generated	Monthly
Month	a.Total Quantity Generated (see Note 8)	b. Hard Rock and Large Broken Concrete (see Note 9)	c. Reused in the Contract	d. Reused in Other Projects	e. Disposed as Public Fill (see Note 10)	f. Imported Fill	g. Metals (see Note 5)	h. Paper / Cardboard Packaging (see Note 5)	i. Plastics (see Note 3) (see Note 5)	j. Chemical Waste	k. Others, e.g. general refuse
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m ³)
January	24.799	0.000	0.000	12.018	12.781	0.000	29.910	0.314	0.000	1.440	0.044
February	12.073	0.000	0.000	5.159	6.914	0.000	20.850	0.473	0.003	0.000	0.022
March	15.990	0.000	0.000	4.489	11.501	0.000	90.810	0.673	0.000	2.400	0.047
April	7.596	0.000	0.000	1.606	5.990	0.000	79.070	0.669	0.000	0.000	0.066
Мау	14.012	0.000	3.608	6.521	3.883	0.000	8.630	0.000	0.000	2.560	0.048
June	58.988	0.000	0.010	56.981	1.997	0.000	154.600	0.586	0.000	0.000	0.057
Sub-total	133.458	0.000	3.618	86.774	43.066	0.000	383.870	2.715	0.003	6.400	0.284
July											
August											
September											
October											
November											
December											
Total	133.458	0.000	3.618	86.774	43.066	0.000	383.870	2.715	0.003	6.400	0.284

Total C&D waste generated = a+b+f+g+h+i+j+k

Total C&D waste generated (excluded excavated material) = g+h+i+j+k

Total C&D waste recycled = c+d+g+h+i

% of recycled C&D waste = (Total C&D waste generated - Total C&D waste recycled) / Total C&D waste generated



	Forecast of Total Quantities of C&D Materials to be Generated from the Contract*									
a.Total Quantity Generated (see Note 8)	b. Hard Rock and Large Broken Concrete (see Note 9)	c. Reused in the Contract	d. Reused in Other Projects	e. Disposed as Public Fill (see Note 10)	f. Imported Fill	g. Metals (see Note 5)	h. Paper / Cardboard Packaging (see Note 5)	i. Plastics (see Note 3) (see Note 5)	j. Chemical Waste	k. Others, e.g. general refuse
(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m ³)

Notes: (1) The performance target are given in PS Clause 6(14)

- (2) The waste flow table shall also include C&D materials that are not specified in the Contract to be imported for use at the Site
- (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material
- (4) The Contractor shall also submit the latest forecast of the amount of C&D materials expected to be generated from the Works, together with a break down of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000m³.
- (5) All recyclable materials, including metals, paper / cardboard packaging, plastics, etc. will be collected by registered collector for recycling.
- (6) Conversion factors for reporting purpose:

in-situ: rock = 2.5 tonnes/m³; soil = 2.0 tonnes/m³

excavated: rock = 2.0 tonnes/m³; soil = 1.8 tonnes/m³; broken concrete and bitumen = 2.4 tonnes/m³

C&D Waste = 0.9 tonnes/m³; bentonite slurry = 2.8 tonnes/m³

Diesel density: 0.8kg/l

- (7) Numbers are rounded off to the nearest three decimal places
- (8) The "Total Quantity Generated" equals to the sum of "Reuse in the Contract", "Reuse in Other Projects" and "Disposed as Public Fill"
- (9) The "Hard Rock and Large Broken Concrete" were disposed as public fill
- (10) The amount in "Disposed as Public Fill" included the "Hard Rock and Large Broken Concrete" disposed as public fill



APPENDIX H

Environmental Licenses and Permits





Environmental License/ Permits /Notification Register

LCAL H2620

							Date : June	2015	
Item No.	Perm Work Area	nit/License o Applica Date	r Registration ation Reference	Permit/License/ Notification/ Registration Description	Permit/License/ Registration Number	Issue/Start Date	Expiry Date	Issuing Office	Remark
1.	All Areas	29 Jul 13	N/A	Environmental Permit to construct the Passenger Clearance Building and associated works of the Hong Kong Zhuhai and Macao Bridge Boundary Crossing Facilities	EP-353/2009/G	06 Aug 13	N/A	EPD	Superseded by EP-353/2009/H
2.	All Areas	16 Jan 15	N/A	Environmental Permit to construct the Passenger Clearance Building and associated works of the Hong Kong Zhuhai and Macao Bridge Boundary Crossing Facilities	EP-353/2009/H	19 Jan 15	N/A	EPD	
3.	All Areas	29 Apr 14	H2620-LTR-EPD- AU-000006	Billing Account for disposal of construction waste	Billing Account No.: 7019944	16 May 14	N/A	EPD	
4.	РСВ	30 Apr 14	H2620-LTR- EPD- 000002	Notification that notifiable works are anticipated to commence (Form NA).	Acknowledge Receipt Ref. No. 373961	05 May 14	N/A	EPD	
5.	WA2	30 Apr 14	H2620-LTR- EPD- 000003	Notification that notifiable works are anticipated to commence (Form NA).	Acknowledge Receipt Ref. No. 373956	05 May 14	N/A	EPD	



Environmental License/ Permits /Notification Register

LCAL H2620

							Date : June	2015	
Item	Permit/License or Registration Application			Permit/License/ Notification/	Permit/License/	Issue/Start	Expiry	Issuing Office	Remark
No.	Work Area	Date	Reference	Registration Description	Registration Number	Date	Date	issuming of mos	
6.	WA3	30 Apr 14	H2620-LTR-EPD- AU-000001	Notification that notifiable works are anticipated to commence (Form NA).	Acknowledge Receipt Ref. No. 373962	05 May 14	N/A	EPD	
7.	РСВ	30 May 14	H2620-LTR-EPD- AU-000020	Registration as Chemical Waste Producer for disposal of spent batteries, used lubrication oil and surplus paint at PCB area	WPN: 5213-951-L2846-01	08 Jul 14	N/A	EPD	
8.	PCB	23 Jun 14	In H2620-LTR- EPD-000017	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore piling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS0683-14	03 Jul 14	29 Dec 14	EPD	Superseded by GW-RS0908-14
9.	WA2	02 Jul 14	H2620-LTR-LCJ- AU-000280	CNP for the use of powered mechanical equipment for the purpose of carry out ER Office construction works from 19:00 to 23:00. (Non-designated area)	GW-RS0715-14	17 Jul 14	15 Jan 15	EPD	Superseded by GW-RS1034-14



Environmental License/ Permits /Notification Register

LCAL H2620

							Date : June 2	2015	
Item No.	Permit/License or Registration Application			Permit/License/ Notification/	Permit/License/ Registration Number	Issue/Start Date	Expiry Date	Issuing Office	Remark
NO.	Work Area Date Reference		Registration Description			Date	_		
10.	WA3	02 Jul 14	H2620-LTR-LCJ- AU-000324	CNP for the use of powered mechanical equipment for the purpose of carry out construction of JV site office from 19:00 to 23:00. (Non-designated)	GW-RS0716-14	17 Jul 14	15 Jan 15	EPD	Expired
11.	PCB	23 Jun 14	H2620-LTR- EPD- 000527	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore piling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS0908-14	03 Sep 14	22 Dec 14	EPD	Superseded by GW-RS1044-14
12.	PCB	15 Sep 14	H2620-LTR-EPD- AU-000034	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore piling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS1044-14	29 Sep 14	24 Dec 14	EPD	Superseded by GW-RS1300-14



Environmental License/ Permits /Notification Register

LCAL H2620

							Date : June	2015		
Item No.	Permit/License or Registration Application Work Area Date Reference		Application Work Date		Permit/License/ Notification/ Registration Description	Permit/License/ Registration Number	Issue/Start Date	Expiry Date	Issuing Office	Remark
13.	WA2	12 Sep 14	H2620-LTR-EPD- AU-000032	CNP for the use of powered mechanical equipment for the purpose of carry out ER Office construction works from 19:00 to 23:00. (Non-designated area)	GW-RS1034-14	29 Sep 14	28 Mar 15	EPD	Expired	
14.	WA4	17 Oct 14	H2620-LTR-EPD- AU-000036	CNP for the use of powered mechanical equipment from 19:00 to 23:00. (Non-designated area)	GW-RW0814-14	20 Oct 14	19 Apr 15	EPD	Superseded by GW-RW0171-15	
15.	PCB	03 Nov 14	H2620-LTR-EPD- AU-000040	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore pilling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS1300-14	17 Nov 14	16 Feb 15	EPD	Superseded by GW-RS0087-15	
16.	PCB	12 Jan 15	H2620-LTR-EPD- AU-000046	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore piling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS0087-15	26 Jan 15	25 Apr 15	EPD	Superseded by GW-RS0308-15	



Environmental License/ Permits /Notification Register

LCAL H2620

	Date : June 2015								
Item No.	Permit/License or Registration Application Work Area Date Reference			Permit/License/ Notification/ Registration Description	Permit/License/ Registration Number	Issue/Start Date	Expiry Date	Issuing Office	Remark
17.	РСВ	12 Mar 15	H2620-LTR-EPD- AU-000051	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore piling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS0308-15	26 Mar 15	25 Jun 15	EPD	Superseded by GW-RS0476-15
18.	PCB	31 Jul 14	H2620-LTR-EPD- AU-000038	Water Discharge License for construction works on PCB island	WT00020335-2014	13 Nov 14	30 Nov 19	EPD	
19.	WA4	27 Mar 15	H2620-LTR-EPD- AU-000054	CNP for the use of powered mechanical equipment from 19:00 to 23:00. (Non-designated area)	GW-RW0171-15	20 Apr 15	19 Oct 15	EPD	
20.	PCB	15 Apr 15	H2620-LTR-EPD- AU-000057	CNP for the use of powered mechanical equipment for the purpose of carry out predrill and bore piling works from 19:00 to 23:00 and 23:00 to 07:00. (Nondesignated area)	GW-RS0476-15	1 May 15	31 July 15	EPD	Superseded by GW-RS0685-15



Environmental License/ Permits /Notification Register

LCAL H2620

							Date : June :	2015		
Item	Permit/License or Registration Application			Permit/License/ Notification/	Permit/License/ Issue/Start	Expiry	Issuing Office	Remark		
No.	Work Area	Date	Reference	Registration Description	Registration Number	Date	Date	localing Gilloc		
21.	PCB	9 Jun 15	H2620-LTR-EPD- EN-000063	CNP for the use of powered mechanical equipment for the purpose of carry out works from 19:00 to 23:00 and 23:00 to 07:00. (Non-designated area)	GW-RS0685-15	1 Jul 15	30 Sep 15	EPD		



APPENDIX I

Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions





Complaint Register

Complain t No.	Complaint Received Date	Category	Complaint Details	Follow up Action /Recommendation	Status
001	22 May 2015	Air Quality and Noise	According to ENPO's email to the ET on 22 May 2015, it was noted that EPD had received a complaint regarding the noise nuisance and dark smoke emission during the night time at HKBCF Project work area recently.	to justify the concerned dark smoke and noise nuisance are related to Contract No. HY/2013/01. In this case, no follow up action is required. However, the Contractor has been reminded to provide maintenance for	Closed.



Statistics on Environmental Complaints, Notifications of Summons and Successful Prosecutions

Poporting Portod	Cumulative Statistics					
Reporting Period	Complaints	Notifications of summons	Successful prosecutions			
This reporting period	1	0	0			
From commencement date of contract to end of reporting period	1	0	0			