

**Contract No. HY/2012/07  
Tuen Mun – Chek Lap Kok Link –  
Southern Connection Viaduct Section**

*Fifty-seventh Monthly EM&A Report*

09 August 2018

**Environmental Resources Management**  
2507, 25/F One Harbourfront  
18 Tak Fung Street  
Hung Hom, Kowloon  
Hong Kong  
Telephone 2271 3000  
Facsimile 2723 5660

[www.erm.com](http://www.erm.com)

# Contract No. HY/2012/07


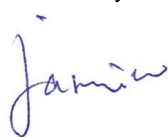


## Tuen Mun – Chek Lap Kok Link – Southern Connection Viaduct Section

**Environmental Resources Management**

2507, 25/F One Harbourfront  
18 Tak Fung Street  
Hung Hom, Kowloon  
Hong Kong  
Telephone: (852) 2271 3000  
Facsimile: (852) 2723 5660  
E-mail: post.hk@erm.com  
http://www.erm.com

*Fifty-seventh Monthly EM&A Report*

**Document Code: 0215660\_57th Monthly EM&A\_20180809.doc**

Client:  Gammon		Project No:  0215660			
Summary:  This document presents the Fifty-seventh Monthly EM&A Report for Tuen Mun – Chek Lap Kok Link – Southern Connection Viaduct Section.		Date: 09 August 2018			
		Approved by: 			
		Mr Craig Reid Partner			
		Certified by: 			
		Dr Jasmine Ng ET Leader			
	Fifty-seventh Monthly EM&A Report	VAR	JT	CAR	09/08/18
Revision	Description	By	Checked	Approved	Date
<p>This report has been prepared by Environmental Resources Management the trading name of 'ERM Hong-Kong, Limited', with all reasonable skill, care and diligence within the terms of the Contract with the client, incorporating our General Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client.</p> <p>We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above.</p>		<p>Distribution</p> <p><input type="checkbox"/> Internal</p> <p><input checked="" type="checkbox"/> Public</p> <p><input type="checkbox"/> Confidential</p>			
		 			

Ref.: HYDHZMBEEM00\_0\_6737L.18

10 August 2018

AECOM  
Supervising Officer's Representative's Office  
780 Cheung Tung Road, Lantau, N.T.

By Fax (3691 2899) and By Post

Attention: Mr. Daniel Ip

Dear Mr. Ip,

**Re: Agreement No. CE 48/2011 (EP)  
Environmental Project Office for the  
HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing  
Facilities, and Tuen Mun-Chek Lap Kok Link – Investigation**

**Contract No. HY/2012/07 TM-CLKL Southern Connection Viaduct  
Section  
57<sup>th</sup> Monthly EM&A Report for July 2018 (EP-354/2009/D)**

Reference is made to the Monthly Environmental Monitoring and Audit (EM&A) Report (July 2018) (ET's ref.: "0215660\_57th Monthly EM&A\_20180809.doc" dated 09 Aug. 2018) certified by the ET Leader and provided to us via e-mail on 9 Aug. 2018.

Please be informed that we have no adverse comments on the captioned Report. We write to verify the captioned submission in accordance with Condition 4.4 of EP-354/2009/D.

Thank you for your attention. Please do not hesitate to contact the undersigned or the ENPO Leader Mr. Y. H. Hui should you have any queries.

Yours sincerely,



F. C. Tsang  
Independent Environmental Checker  
Tuen Mun – Chek Lap Kok Link

c.c. HyD – Mr. Stephen Chan (By Fax: 3188 6614)  
HyD – Mr. Vico Cheung (By Fax: 3188 6614)  
AECOM – Mr. Conrad Ng (By Fax: 3922 9797)  
ERM – Dr. Jasmine Ng (By Fax: 2723 5660)  
Gammon – Mr. Roy Leung (By Fax: 3520 0486)

Internal: DY, YH, DF, ENPO Site

Q:\Projects\HYDHZMBEEM00\02\_Proj\_Mgt\02\_Corr\2018\HYDHZMBEEM00\_0\_6737L.18.docx

## TABLE OF CONTENTS

	<i>EXECUTIVE SUMMARY</i>	<i>I</i>
<i>1</i>	<i>INTRODUCTION</i>	<i>1</i>
<i>1.1</i>	<i>BACKGROUND</i>	<i>1</i>
<i>1.2</i>	<i>SCOPE OF REPORT</i>	<i>2</i>
<i>1.3</i>	<i>ORGANIZATION STRUCTURE</i>	<i>2</i>
<i>1.4</i>	<i>SUMMARY OF CONSTRUCTION WORKS</i>	<i>3</i>
<i>2</i>	<i>EM&amp;A RESULTS</i>	<i>6</i>
<i>2.1</i>	<i>AIR QUALITY</i>	<i>6</i>
<i>2.2</i>	<i>NOISE MONITORING</i>	<i>8</i>
<i>2.3</i>	<i>WATER QUALITY MONITORING</i>	<i>9</i>
<i>2.4</i>	<i>DOLPHIN MONITORING</i>	<i>11</i>
<i>2.5</i>	<i>EM&amp;A SITE INSPECTION</i>	<i>15</i>
<i>2.6</i>	<i>WASTE MANAGEMENT STATUS</i>	<i>16</i>
<i>2.7</i>	<i>ENVIRONMENTAL LICENSES AND PERMITS</i>	<i>17</i>
<i>2.8</i>	<i>IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES</i>	<i>19</i>
<i>2.9</i>	<i>SUMMARY OF EXCEEDANCES OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMIT</i>	<i>19</i>
<i>2.10</i>	<i>SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS</i>	<i>19</i>
<i>3</i>	<i>FUTURE KEY ISSUES</i>	<i>20</i>
<i>3.1</i>	<i>CONSTRUCTION PROGRAMME FOR THE COMING MONTH</i>	<i>20</i>
<i>3.2</i>	<i>KEY ISSUES FOR THE COMING MONTH</i>	<i>20</i>
<i>3.3</i>	<i>MONITORING SCHEDULE FOR THE COMING MONTH</i>	<i>20</i>
<i>4</i>	<i>CONCLUSIONS AND RECOMMENDATIONS</i>	<i>21</i>
<i>4.1</i>	<i>CONCLUSIONS</i>	<i>21</i>

### List of Appendices

- Appendix A Project Organization for Environmental Works
- Appendix B Three Month Rolling Construction Programmes
- Appendix C Implementation Schedule of Environmental Mitigation Measures (EMIS)
- Appendix D Summary of Action and Limit Levels
- Appendix E Calibration Certificates of Monitoring Equipment
- Appendix F EM&A Monitoring Schedules
- Appendix G Impact Air Quality Monitoring Results and Graphical Presentation
- Appendix H Meteorological Data for the Reporting Month
- Appendix I Impact Noise Monitoring Results and Graphical Presentation
- Appendix J Impact Water Quality Monitoring Results and Graphical Presentation
- Appendix K Impact Dolphin Monitoring Survey Results
- Appendix L Event Action Plan
- Appendix M Monthly Summary of Waste Flow Table
- Appendix N Cumulative Statistics on Exceedances, Complaints, Notifications of Summons and Successful Prosecutions

## **EXECUTIVE SUMMARY**

Under *Contract No. HY/2012/07*, Gammon Construction Limited (GCL) is commissioned by the Highways Department (HyD) to undertake the design and construction of the Southern Connection Viaduct Section of the Tuen Mun – Chek Lap Kok Link Project (TM-CLK Link Project) while AECOM Asia Company Limited was appointed by HyD as the Supervising Officer. For implementation of the environmental monitoring and audit (EM&A) programme under the Contract, ERM-Hong Kong, Limited (ERM) has been appointed as the Environmental Team (ET). Ramboll Hong Kong Ltd. was employed by the HyD as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) in accordance with *Environmental Permit No. EP-354/2009/A*. Further applications for variation of environmental permit (VEP), *EP-354/2009/B*, *EP-354/2009/C* and *EP-354/2009/D*, were granted on 28 January 2014, 10 December 2014 and 13 March 2015, respectively.

The southern landfall of TM-CLK Link lies alongside the Hong Kong - Zhuhai - Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) where a reclamation area is constructed by *Contract No. HY/2010/02* under *Environmental Permit No. EP-353/2009/K* and *EP-354/2009/D*. Upon the agreement and confirmation between the Supervising Officer Representatives and Contractors of *HY/2010/02* and *HY/2012/07* in September 2015, part of the reclamation area for southern landfall under *EP-353/2009/K* and *EP-354/2009/D* was handed-over to *Contract No. HY/2012/07*. Another part of the southern landfall area under *EP-354/2009/D* was handed-over to *Contract No. HY/2012/07* after completion of reclamation works by *Contract No. HY/2010/02* in June 2016.

The construction phase of the Contract commenced on 31 October 2013 and will be tentatively completed by 2018. The impact monitoring of the EM&A programme, including air quality, noise, water quality and marine ecological monitoring as well as environmental site inspections, commenced on 31 October 2013.

This is the Fifty-seventh Monthly EM&A report presenting the EM&A works carried out during the period from 1 to 31 July 2018 for the Southern Connection Viaduct Section in accordance with the Updated EM&A Manual of the TM-CLK Link Project. As informed by the Contractor, major activities in the reporting period included:

### ***Land-based Works***

- Pier construction;
- Re-alignment of Cheung Tung Road;
- Road works along North Lantau Highway;
- Installation of pier head and deck segments;

- Asphalt paving;
- Construction of sign gantries, light poles and street furniture;
- Parapets and barriers installation; and
- Slope work of Viaducts A, B, C & D.

A summary of monitoring and audit activities conducted in the reporting period is listed below:

24-hour TSP Monitoring	6 sessions
1-hour TSP Monitoring	6 sessions
Water Quality Monitoring	13 sessions
Noise Monitoring	6 sessions
Impact Dolphin Monitoring	2 sessions
Joint Environmental Site Inspection	4 sessions

#### **Breaches of Action and Limit Levels for Air Quality**

No exceedance of Action and Limit Levels was recorded for construction air quality monitoring in the reporting month.

#### **Breaches of Action and Limit Levels for Noise**

No exceedance of Action and Limit Levels was recorded for construction air quality monitoring in the reporting month.

#### **Breaches of Action and Limit Levels for Water Quality**

Four (4) Action Level and one (1) Limit Level of Dissolved Oxygen (DO) exceedances and one (1) Limit Level of Suspended Solids exceedance were recorded for water quality impact monitoring in the reporting month.

#### **Impact Dolphin Monitoring**

During this month of dolphin monitoring, no unacceptable impact from the construction activities of the TM-CLKL Southern Connection Viaduct Section on Indo-Pacific humpback dolphin *Sousa chinensis* (i.e. Chinese White Dolphin) was noticeable from general observations. Due to monthly variation in dolphin occurrence within the Study Area, it would be more appropriate to draw conclusion on whether any impacts on dolphins have been detected related to the construction activities of the TM-CLKL Southern Connection Viaduct Section in the quarterly EM&A reports, in which comparison on distribution, group size and encounter rates of dolphins between the quarterly impact monitoring period and baseline monitoring period will be made.

Daily marine mammal exclusion zone monitoring was undertaken during the period of marine works under this Contract. No sighting of the Chinese White Dolphin was recorded in July 2018 during the exclusion zone monitoring.

### **Environmental Complaints, Non-compliance & Summons**

No complaints, notification of summons or successful prosecution recorded in the reporting period.

### **Summary of Marine Travel Route record**

No non-compliance with EIA recommendations, EP conditions and other requirements associated with the marine travel route record of this Contract was recorded in April 2018. As confirmed by the Contractor, no further marine travel across the site boundary under this Contract after April 2018.

### **Reporting Change**

There was no reporting change in the reporting period.

### **Upcoming Works for the Next Reporting Period**

Works to be undertaken in the next monitoring period of August 2018 include the following:

#### ***Land-based Works***

- Pier construction;
- Demolition of marine platform;
- Re-alignment of Cheung Tung Road;
- Road works along North Lantau Highway;
- Installation of pier head and deck segments;
- Asphalt paving;
- Construction of sign gantries, light poles and street furniture;
- Parapets and barriers installation; and
- Slope work of Viaducts A, B, C & D.

### **Future Key Issues**

Potential environmental impacts arising from the above upcoming construction activities in the next reporting month of August 2018 are mainly associated with dust, noise, marine water quality, marine ecology and waste management issues.



## 1.1

## BACKGROUND

According to the findings of the Northwest New Territories (NWNT) Traffic and Infrastructure Review conducted by the Transport Department, Tuen Mun Road, Ting Kau Bridge, Lantau Link and North Lantau Highway would be operating beyond capacity after 2016. This forecast has been based on the estimated increase in cross boundary traffic, developments in the Northwest New Territories (NWNT), and possible developments in North Lantau, including the Airport developments, the Lantau Logistics Park (LLP) and the Hong Kong - Zhuhai - Macao Bridge (HZMB). In order to cope with the anticipated traffic demand, two new road sections between NWNT and North Lantau - Tuen Mun - Chek Lap Kok Link (TM-CLKL) and Tuen Mun Western Bypass (TMWB) are proposed.

An Environmental Impact Assessment (EIA) of TM-CLKL (the Project) was prepared in accordance with the EIA Study Brief (No. ESB-175/2007) and the *Technical Memorandum of the Environmental Impact Assessment Process (EIAO-TM)*. The EIA Report was submitted under the Environmental Impact Assessment Ordinance (EIAO) in August 2009. Subsequent to the approval of the EIA Report (EIAO Register Number AEIAR-146/2009), an Environmental Permit (EP-354/2009) for TM-CLKL was granted by the Director of Environmental Protection (DEP) on 4 November 2009, and EP variation (EP-354/2009/A) was issued on 8 December 2010.

Under *Contract No. HY/2012/07*, Gammon Construction Limited (GCL) is commissioned by the Highways Department (HyD) to undertake the design and construction of the Southern Connection Viaduct Section of TM-CLKL ("the Contract") while AECOM Asia Company Limited was appointed by HyD as the Supervising Officer. For implementation of the environmental monitoring and audit (EM&A) programme under the Contract, ERM-Hong Kong, Limited (ERM) has been appointed as the Environmental Team (ET). Ramboll Hong Kong Ltd. was employed by HyD as the Independent Environmental Checker (IEC) and Environmental Project Office (ENPO) in accordance with *Environmental Permit No. EP-354/2009/A*. Further applications for variation of environmental permit (VEP), *EP-354/2009/B*, *EP-354/2009/C* and *EP-354/2009/D*, were granted on 28 January 2014, 10 December 2014 and 13 March 2015, respectively.

The southern landfall of TM-CLK Link lies alongside the Hong Kong - Zhuhai - Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) where a reclamation area is constructed by *Contract No. HY/2010/02* under *Environmental Permit No. EP-353/2009/K* and *EP-354/2009/D*. Upon the agreement and confirmation between the Supervising Officer Representatives and Contractors of *HY/2010/02* and *HY/2012/07* in September 2015, part of the reclamation area for southern landfall under *EP-353/2009/K* and *EP-354/2009/D* was handed-over to *Contract No. HY/2012/07*. Another part of the

southern landfall area under *EP-354/2009/D* was handed-over to *Contract No. HY/2012/07* after completion of reclamation works by *Contract No. HY/2010/02* in June 2016.

The construction phase of the Contract commenced on 31 October 2013 and will be tentatively completed by 2018. The impact monitoring phase of the EM&A programme, including air quality, noise, water quality and marine ecological monitoring as well environmental site inspections, commenced on 31 October 2013.

The general layout plan of the Contract components is presented in *Figures 1.1 & 1.2a to l*.

## **1.2 SCOPE OF REPORT**

This is the Fifty-seventh Monthly EM&A Report under the *Contract No. HY/2012/07 Tuen Mun – Chek Lap Kok Link – Southern Connection Viaduct Section*. This report presents a summary of the environmental monitoring and audit works in July 2018.


## **1.3 ORGANIZATION STRUCTURE**

The organization structure of the Contract is shown in *Appendix A*. The key personnel contact names and contact details are summarized in *Table 1.1* below.





DO NOT SCALE DRAWING. CHECK ALL DIMENSIONS ON SITE.

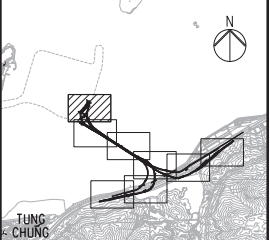

**KEY PLAN**

**NOTES**  
 1. THIS DRAWING SHALL BE READ IN CONJUNCTION WITH DRAWING NO. J3518/P/OAP/04/1000 AND OTHER RELEVANT DRAWINGS.

- LEGEND**
- SITE BOUNDARY
  - GF1 FAULT
  - EXISTING G.I.-STATIONS :
    - ⊕ BOREHOLE BY GIU DATA EXCLUDING VC
    - ⊕ BOREHOLE BY GCL CONTRACT HY/2012/04
    - ⊕ BOREHOLE BY GCL CONTRACT NL8/97
    - ⊕ BOREHOLE BY GCL CONTRACT HY/2009/23
    - ⊕ TRIAL PIT BY GCL CONTRACT HY/2012/04
  - SLOPE STRIPPING BY GCL CONTRACT HY/2012/04
  - PROPOSED G.I.-STATIONS :
    - ⊕ PBH01 PROPOSED BOREHOLE
    - ⊕ TP01 PROPOSED TRIAL PIT
    - ⊕ CH01 PROPOSED COREHOLE
    - SS01 SS02 PROPOSED SLOPE STRIPPING

MATCH LINE  
 FOR CONTINUATION  
 SEE DRG. J3518/P/OAP/04/01101



Printed by : 12/09/2013  
 File name : E:\3518\99\REC\DRG\20130927\Ground Investigation Plan\CAD\231498\_P\_OAP\_04\_01000.dwg

Rev	Description	By	Date	Rev	Description	By	Date
A	SUBMISSION	RC	07/13				
B	SUBMISSION	RC	07/13				
C	SUBMISSION	RC	09/13				

Drawn	Date	Client
RL	07/13	HONG KONG HIGHWAYS DEPARTMENT 路政署 香港 九龍 新界 沙田 香港 九龍 新界 沙田 香港 九龍 新界 沙田
Checked	Approved	
DS	DOP	
Scale	1:1000 @ A1 / 1:2000 @ A3	

Supervising Officer: **AECOM**



Contractor: **GAMMON**

Project Title  
 Contract No. HY/2012/07  
 Tuen Mun - Chek Lap Kok Link  
 Southern Connection Viaduct Section

Drawing title  
**Figure 1.2b**

Drawing no. J3518/P/OAP/04/01100 Rev. C

DO NOT SCALE DRAWING. CHECK ALL DIMENSIONS ON SITE.

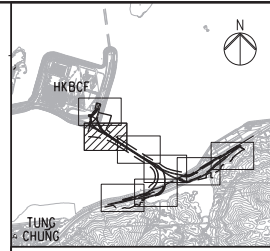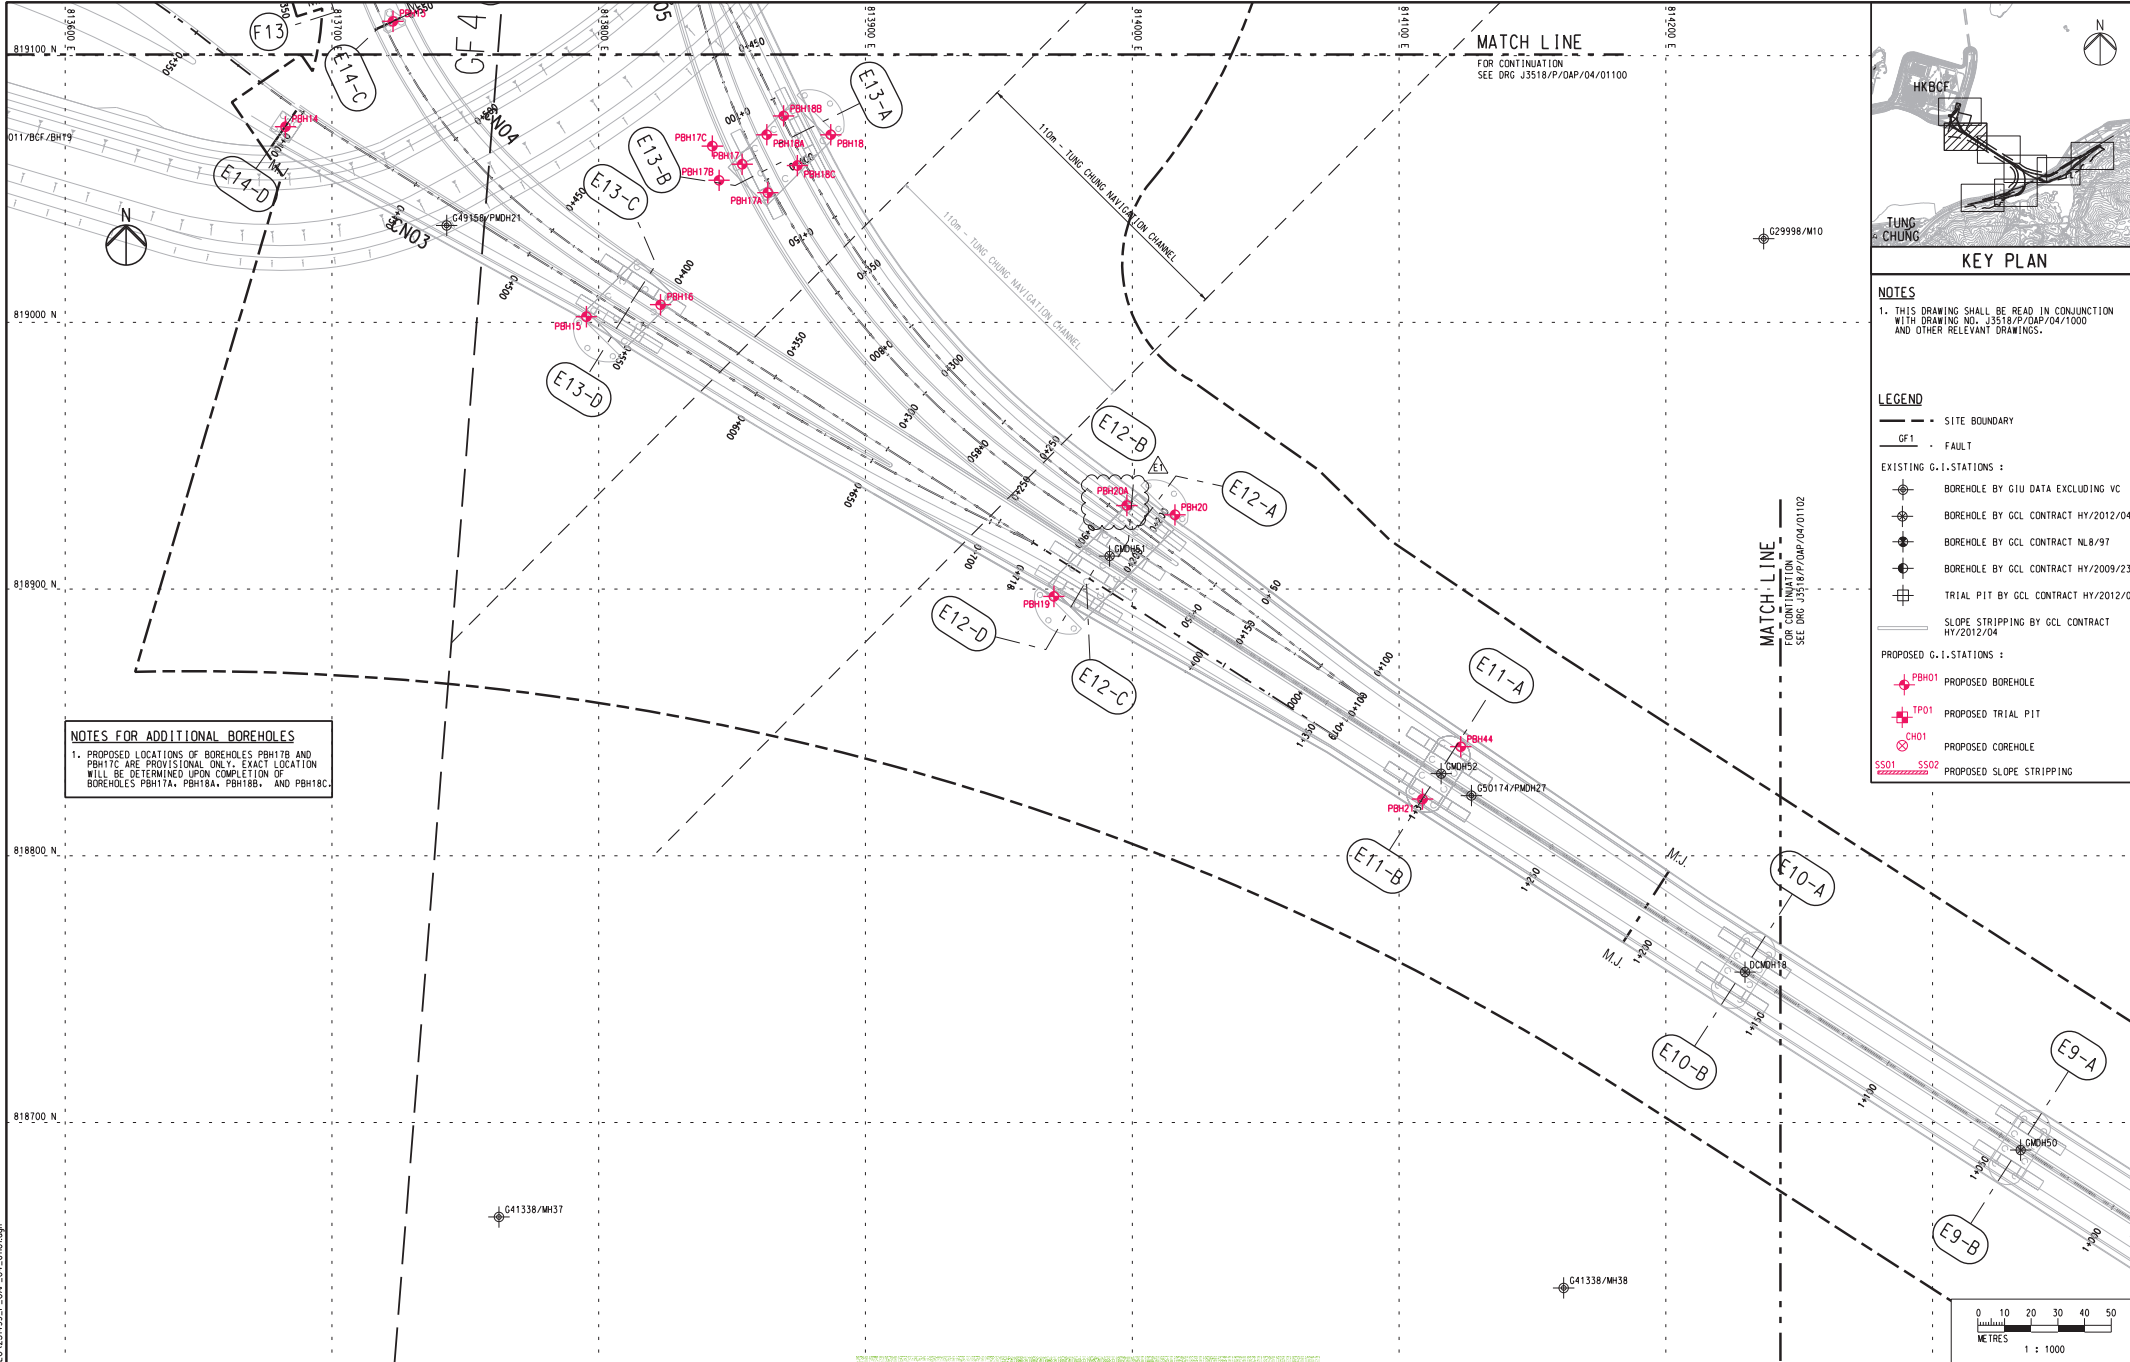

**KEY PLAN**

**NOTES**  
 1. THIS DRAWING SHALL BE READ IN CONJUNCTION WITH DRAWING NO. J3518/P/OAP/04/1000 AND OTHER RELEVANT DRAWINGS.

- LEGEND**
- - - SITE BOUNDARY
  - GF1 FAULT
  - EXISTING G.I. STATIONS :
    - ⊕ BOREHOLE BY GIU DATA EXCLUDING VC
    - ⊕ BOREHOLE BY GCL CONTRACT HY/2012/04
    - ⊕ BOREHOLE BY GCL CONTRACT NL8/97
    - ⊕ BOREHOLE BY GCL CONTRACT HY/2009/23
    - ⊕ TRIAL PIT BY GCL CONTRACT HY/2012/04
  - PROPOSED G.I. STATIONS :
    - ⊕ PBH01 PROPOSED BOREHOLE
    - ⊕ TP01 PROPOSED TRIAL PIT
    - ⊕ CH01 PROPOSED COREHOLE
    - SS01 SS02 PROPOSED SLOPE STRIPPING

**NOTES FOR ADDITIONAL BOREHOLES**  
 1. PROPOSED LOCATIONS OF BOREHOLES PBH17B AND PBH17C ARE PROVISIONAL ONLY. EXACT LOCATION WILL BE DETERMINED UPON COMPLETION OF BOREHOLES PBH17A, PBH18A, PBH18B, AND PBH18C.

P:\Printed by : 05.11.13  
 File name : E:\23499.WRP\GEO\23499\_P\_OAP\_04\_01001.dgn

Rev	Description	By	Date	Rev	Description	By	Date
A	SUBMISSION	RC	07/13				
B	SUBMISSION	RC	07/13				
C	SUBMISSION	RC	09/13				
D	SUBMISSION	RC	10/13				
E1	FOR INTERNAL REVIEW	RC	11/13				

Drawn	Date	Client
RL	07/13	HIGHWAYS DEPARTMENT


  

Checked	Approved	Scale
DS	DOP	1:1000 @ A1; 1:2000 @ A3



SUPERVISING OFFICER  
 CONTRACTOR

Project Title  
**Contract No. HY/2012/07**  
**Tuen Mun - Chek Lap Kok Link**  
**Southern Connection Viaduct Section**

Drawing title  
**Figure 1.2c**  
 Drawing no. **J3518/P/OAP/04/01101** Rev. **E1**




DO NOT SCALE DRAWING. CHECK ALL DIMENSIONS ON SITE.

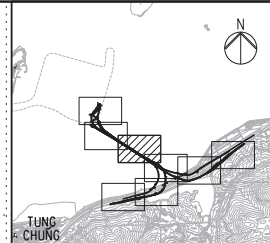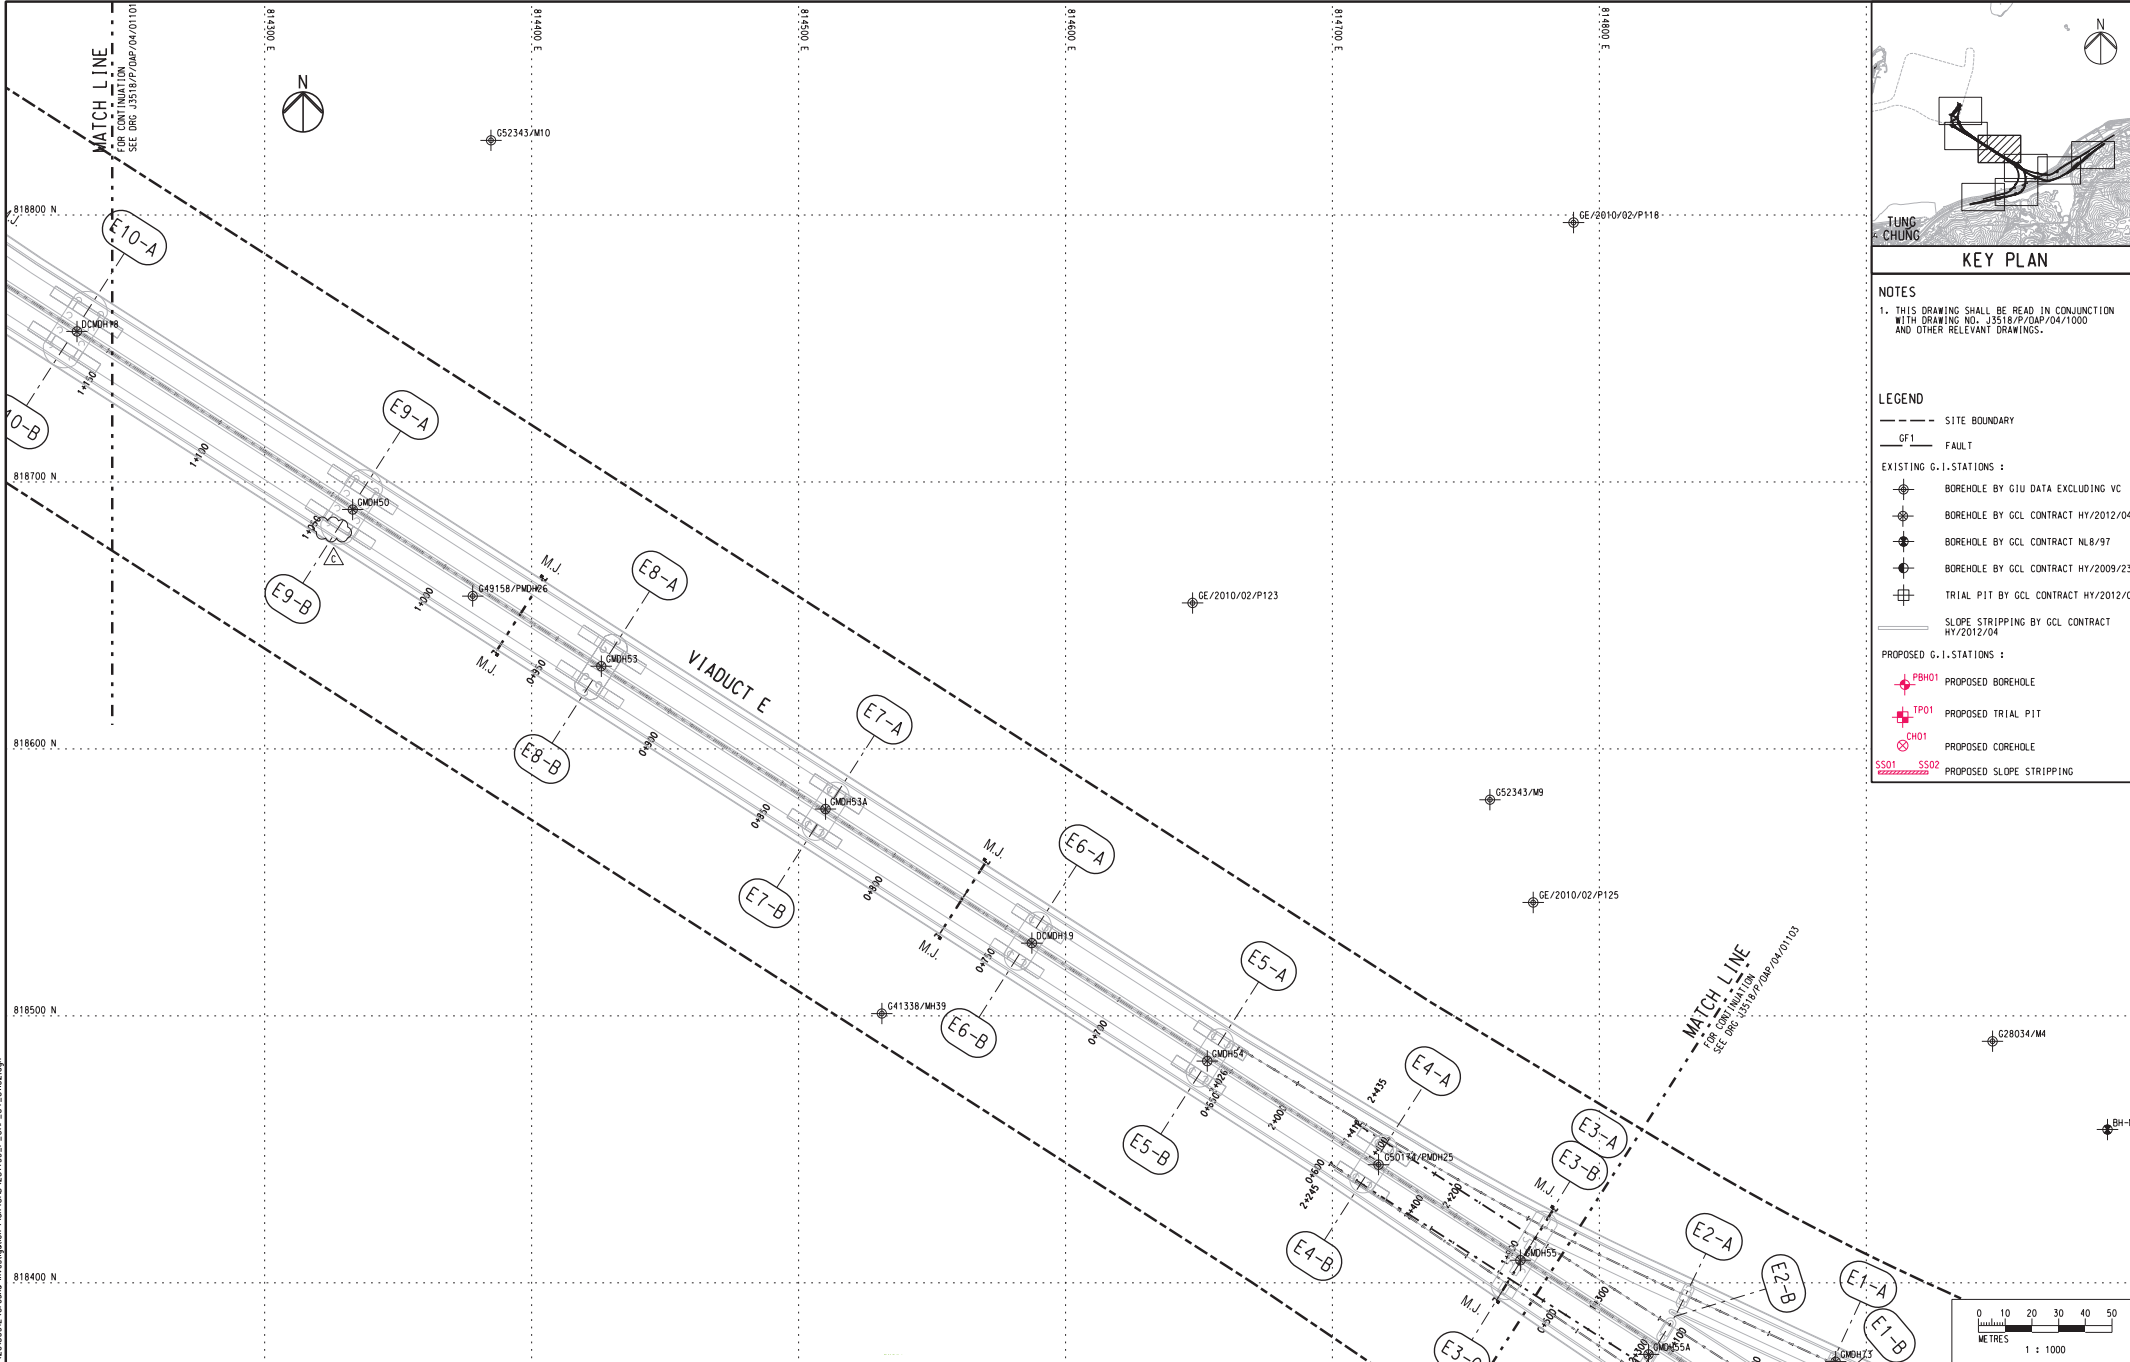

**KEY PLAN**

**NOTES**  
 1. THIS DRAWING SHALL BE READ IN CONJUNCTION WITH DRAWING NO. J3518/P/OAP/04/1000 AND OTHER RELEVANT DRAWINGS.

- LEGEND**
- SITE BOUNDARY
  - GF1- FAULT
  - EXISTING G.I.-STATIONS :
  - ⊕ BOREHOLE BY GIU DATA EXCLUDING VC
  - ⊕ BOREHOLE BY GCL CONTRACT HY/2012/04
  - ⊕ BOREHOLE BY GCL CONTRACT NL8/97
  - ⊕ BOREHOLE BY GCL CONTRACT HY/2009/23
  - ⊕ TRIAL PIT BY GCL CONTRACT HY/2012/04
  - SLOPE STRIPPING BY GCL CONTRACT HY/2012/04
  - PROPOSED G.I.-STATIONS :
  - ⊕ PBH01 PROPOSED BOREHOLE
  - ⊕ TP01 PROPOSED TRIAL PIT
  - ⊕ CH01 PROPOSED COREHOLE
  - SS01 SS02 PROPOSED SLOPE STRIPPING

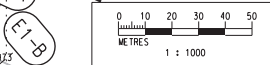

Printed by : 12/09/2013 File name : J:\3518\99\REC\000\20130912\Ground Investigation\Plan\CAD\23498\_P\_OAP\_04\_01102.dgn

Rev	Description	By	Date	Rev	Description	By	Date
A	SUBMISSION	RC	07/13				
B	SUBMISSION	RC	07/13				
C	SUBMISSION	RC	09/13				

Checked	Approved
DS	DOP

Scale
1:1000 @ A1 / 1:2000 @ A3

Client

Supervising Officer

Project Title

Contract No. HY/2012/07  
 Tuen Mun - Chek Lap Kok Link  
 Southern Connection Viaduct Section

Contractor

Originator

Drawing title



# Figure 1.2d

Drawing no. J3518/P/OAP/04/01102 Rev. C





DO NOT SCALE DRAWING. CHECK ALL DIMENSIONS ON SITE.

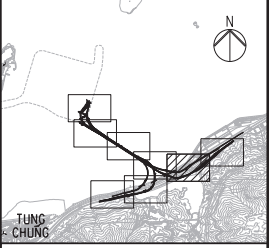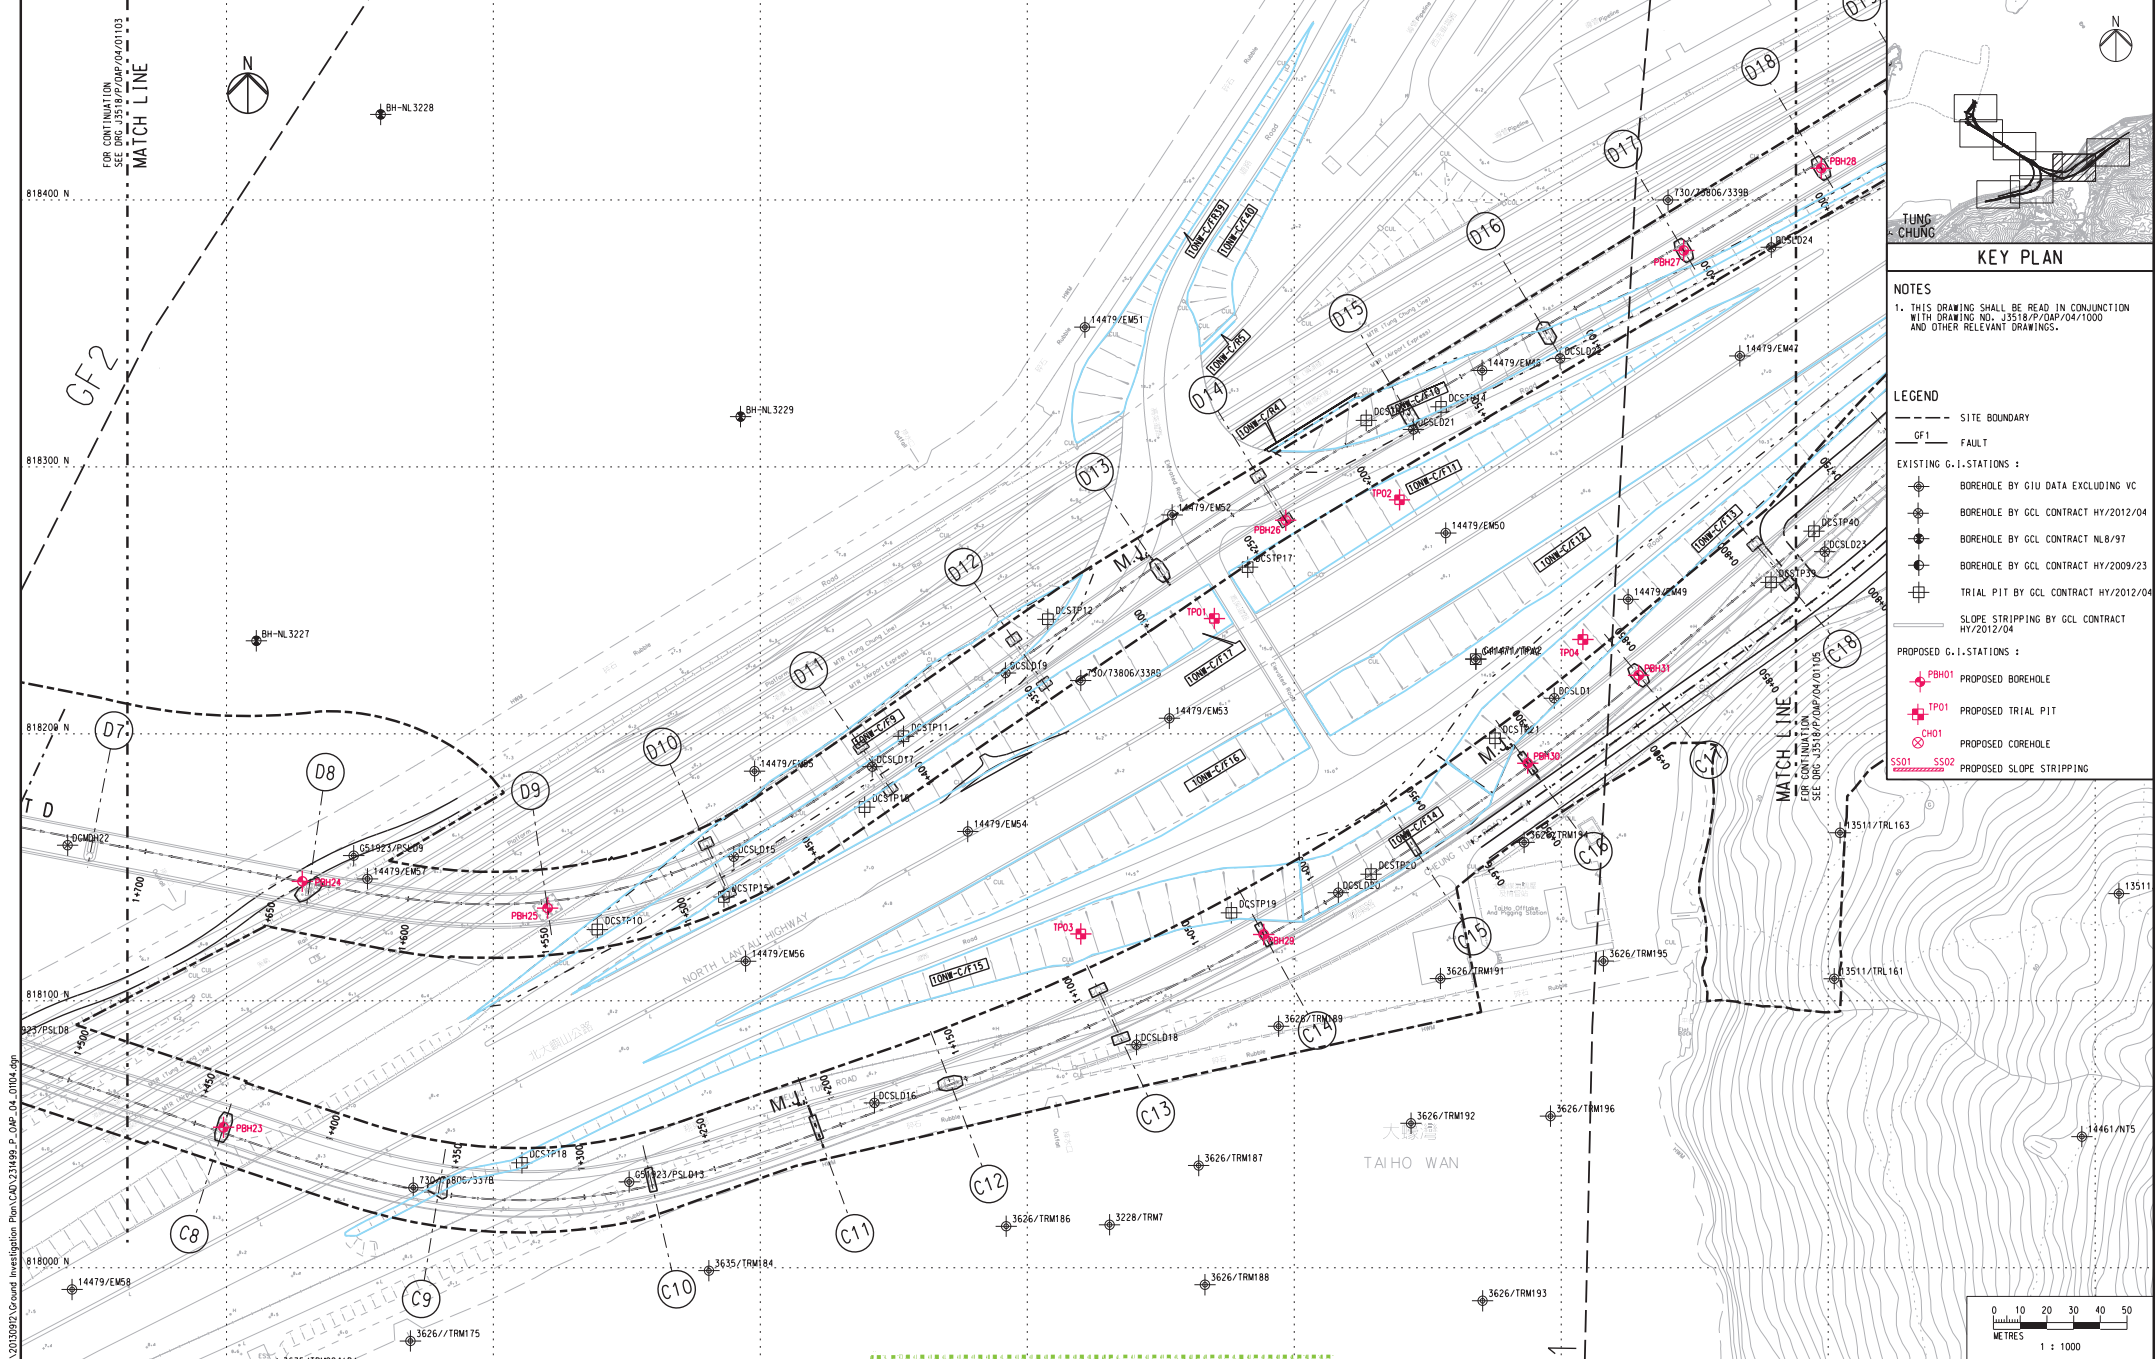

**KEY PLAN**

**NOTES**  
 1. THIS DRAWING SHALL BE READ IN CONJUNCTION WITH DRAWING NO. J3518/P/OAP/04/1000 AND OTHER RELEVANT DRAWINGS.

- LEGEND**
- - - SITE BOUNDARY
  - GF1 FAULT
  - EXISTING G.I. STATIONS :
    - ⊕ BOREHOLE BY GIU DATA EXCLUDING VC
    - ⊕ BOREHOLE BY GCL CONTRACT HY/2012/04
    - ⊕ BOREHOLE BY GCL CONTRACT NL6/97
    - ⊕ BOREHOLE BY GCL CONTRACT HY/2009/23
    - ⊕ TRIAL PIT BY GCL CONTRACT HY/2012/04
  - PROPOSED G.I. STATIONS :
    - ⊕ PBH01 PROPOSED BOREHOLE
    - ⊕ TP01 PROPOSED TRIAL PIT
    - ⊕ CH01 PROPOSED COREHOLE
    - SS01 SS02 PROPOSED SLOPE STRIPPING

Printed by : 12/09/2013  
 File name : J:\3518\99\RECORD\20120927\_Ground Investigation Plan\CAD\231498\_P\_OAP\_04\_01100.dwg  
 Record : 20120927\_Ground Investigation Plan\CAD\231498\_P\_OAP\_04\_01100.dwg

Rev	Description	By	Date	Rev	Description	By	Date	Drawn	Date
A	SUBMISSION	RC	07/13					RL	07/13
B	SUBMISSION	RC	07/13					Checked	Approved
C	SUBMISSION	RC	09/13					DS	DOP
								Scale	1:1000 @ A1 / 1:2000 @ A3

Client

Supervising Officer

Project Title

Contract No. HY/2012/07  
 Tuen Mun - Chek Lap Kok Link  
 Southern Connection Viaduct Section

Contractor

Originator

Drawing title

# Figure 1.2f


Drawing no. J3518/P/OAP/04/01104 Rev. C









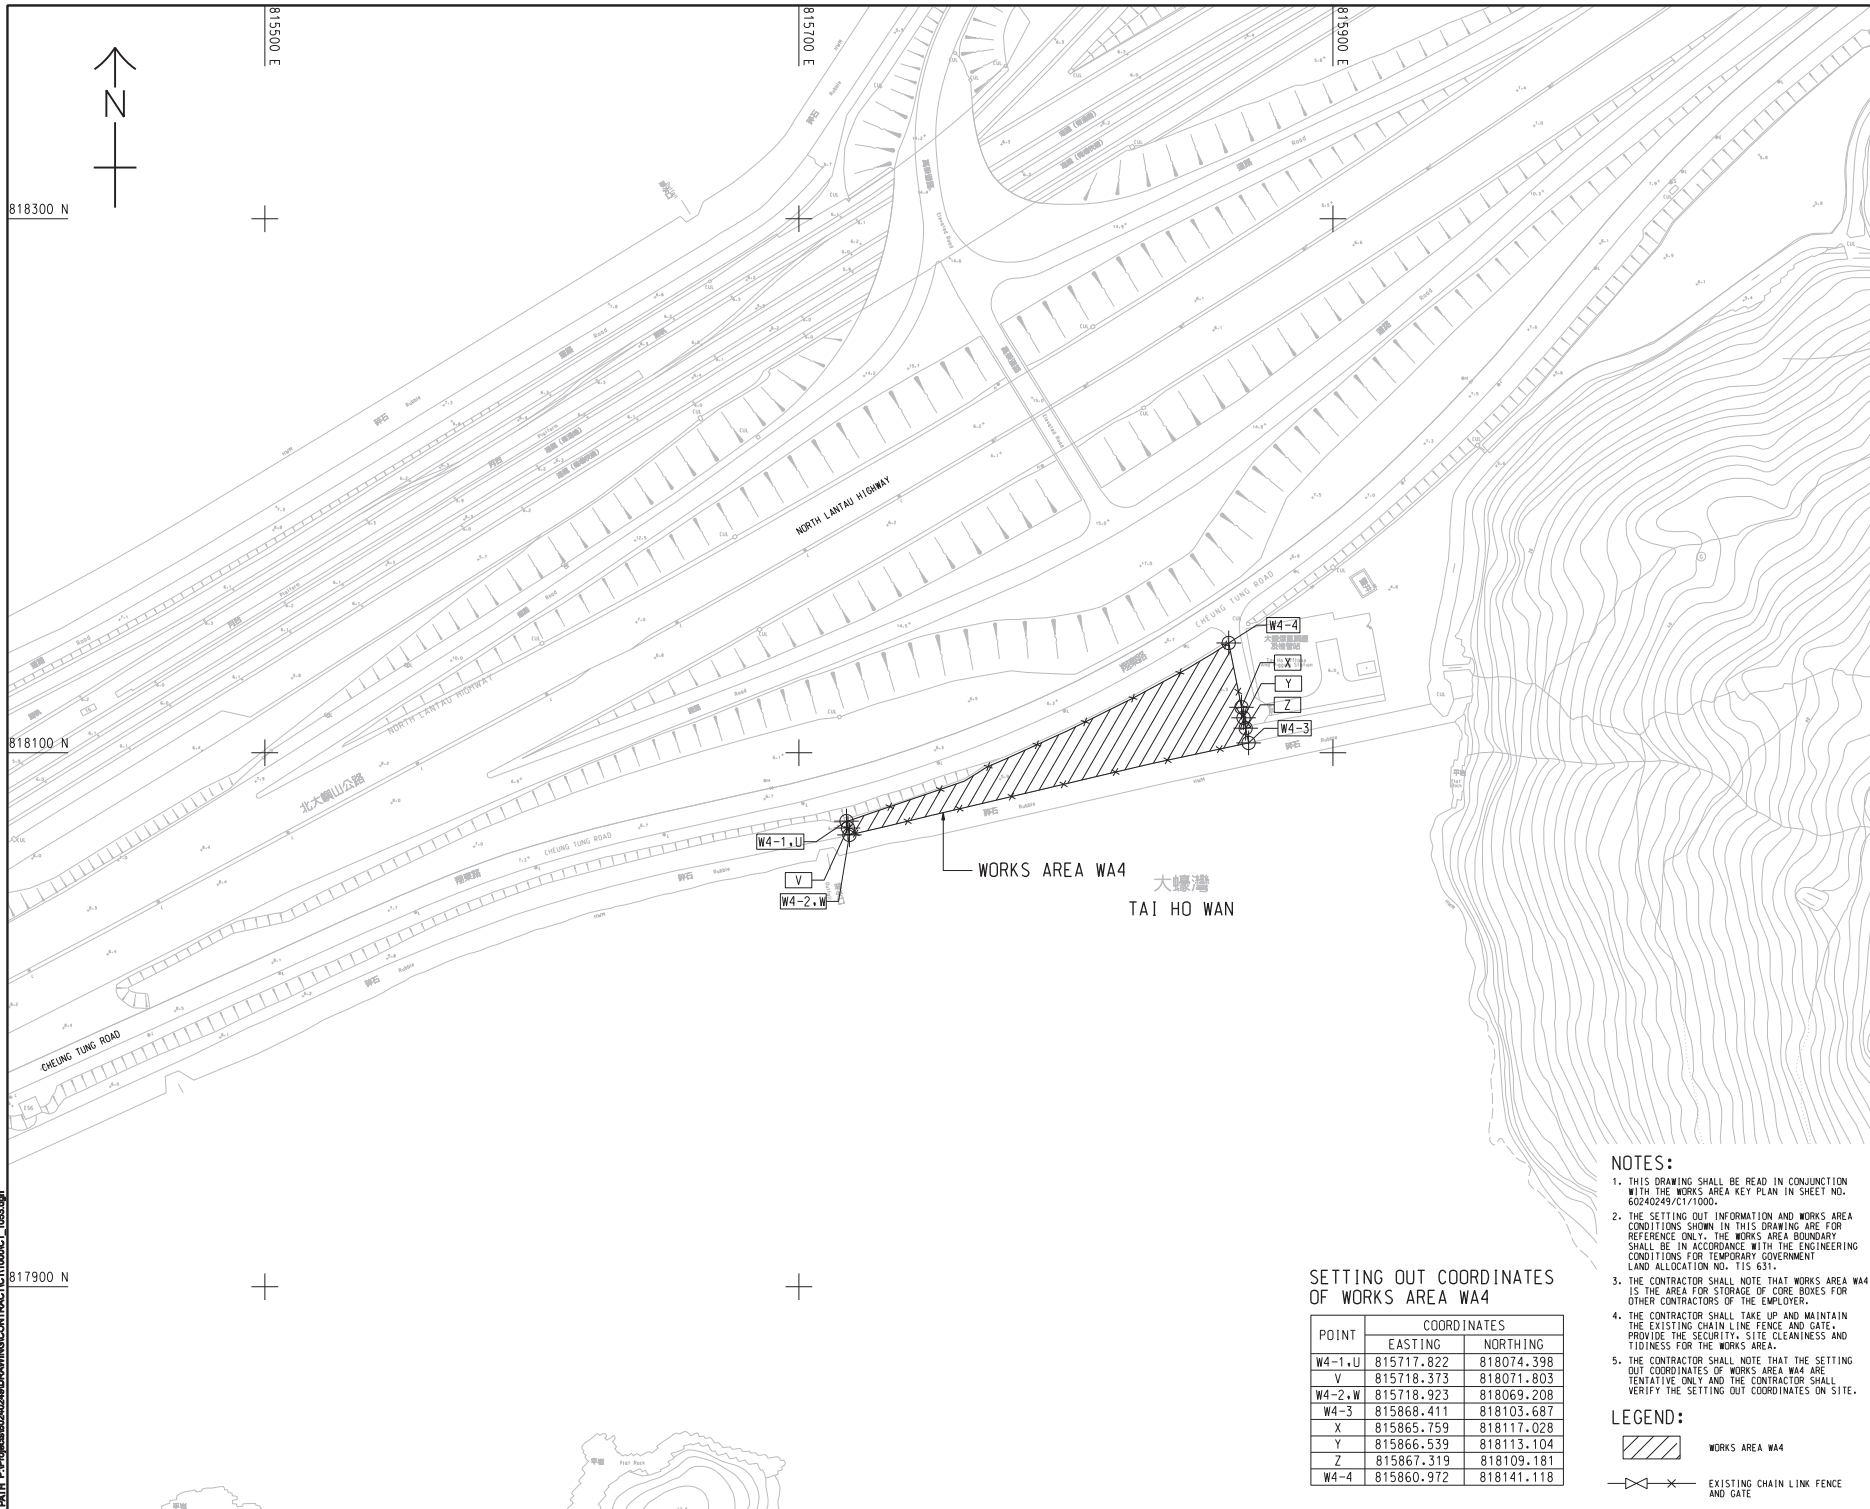

SETTING OUT COORDINATES OF WORKS AREA WA4

POINT	COORDINATES	
	EASTING	NORTHING
W4-1,U	815717.822	818074.398
V	815718.373	818071.803
W4-2,W	815718.923	818069.208
W4-3	815868.411	818103.687
X	815865.759	818117.028
Y	815866.539	818113.104
Z	815867.319	818109.181
W4-4	815860.972	818141.118

- NOTES:**
- THIS DRAWING SHALL BE READ IN CONJUNCTION WITH THE WORKS AREA KEY PLAN IN SHEET NO. 60240249/C1/100.
  - THE SETTING OUT INFORMATION AND WORKS AREA CONDITIONS SHOWN IN THIS DRAWING ARE FOR REFERENCE ONLY. THE WORKS AREA BOUNDARY SHALL BE IN ACCORDANCE WITH THE ENGINEERING CONDITIONS FOR TEMPORARY GOVERNMENT LAND ALLOCATION NO. T15 631.
  - THE CONTRACTOR SHALL NOTE THAT WORKS AREA WA4 IS THE AREA FOR STORAGE OF CORE BOXES FOR OTHER CONTRACTORS OF THE EMPLOYER.
  - THE CONTRACTOR SHALL TAKE UP AND MAINTAIN THE EXISTING CHAIN LINK FENCE AND GATE. PROVIDE THE SECURITY, SITE CLEANLINESS AND TIDINESS FOR THE WORKS AREA.
  - THE CONTRACTOR SHALL NOTE THAT THE SETTING OUT COORDINATES OF WORKS AREA WA4 ARE TENTATIVE ONLY AND THE CONTRACTOR SHALL VERIFY THE SETTING OUT COORDINATES ON SITE.

**LEGEND:**

WORKS AREA WA4

EXISTING CHAIN LINK FENCE AND GATE

**AECOM**

**PROJECT**  
 TUEN MUN - CHEK LAP KOK LINK

**CONTRACT TITLE**  
 TUEN MUN - CHEK LAP KOK LINK - SOUTHERN CONNECTION VIADUCT SECTION

**CLIENT**  
 路政署 DEPARTMENT OF HIGHWAYS  
 港務局工程司管理處  
 Hong Kong + Zhuhai + Hainan Bridge  
 Hong Kong Project Management Office

**CONSULTANT**  
 AECOM Asia Company Ltd.  
 www.aecom.com

**SUB-CONSULTANTS**  
 2/11/2012/11/16

**Figure 1.2j**

**ISSUE/REVISION**

NO.	DATE	DESCRIPTION	CHK.
1	NOV. 12	TENDER ADDENDUM NO. 1	C/W

**SCALE**  
 A1 : 1:1000

**DIMENSION UNIT**  
 METRES

**KEY PLAN**

**PROJECT NO.**  
 60240249



**CONTRACT NO.**  
 HY/2012/07

**SHEET TITLE**  
 WORKS AREA WA4

**SHEET NUMBER**  
 60240249/C1/1053


This drawing has been prepared for the use of AECOM, except as may be otherwise approved by AECOM, and shall not be used for any other purpose without the written consent of AECOM. Do not scale this drawing. All measurements must be taken from the actual dimensions.

DO NOT SCALE DRAWING. CHECK ALL DIMENSIONS ON SITE.

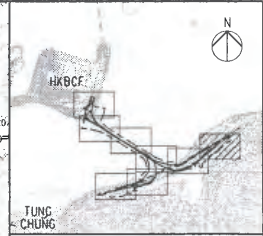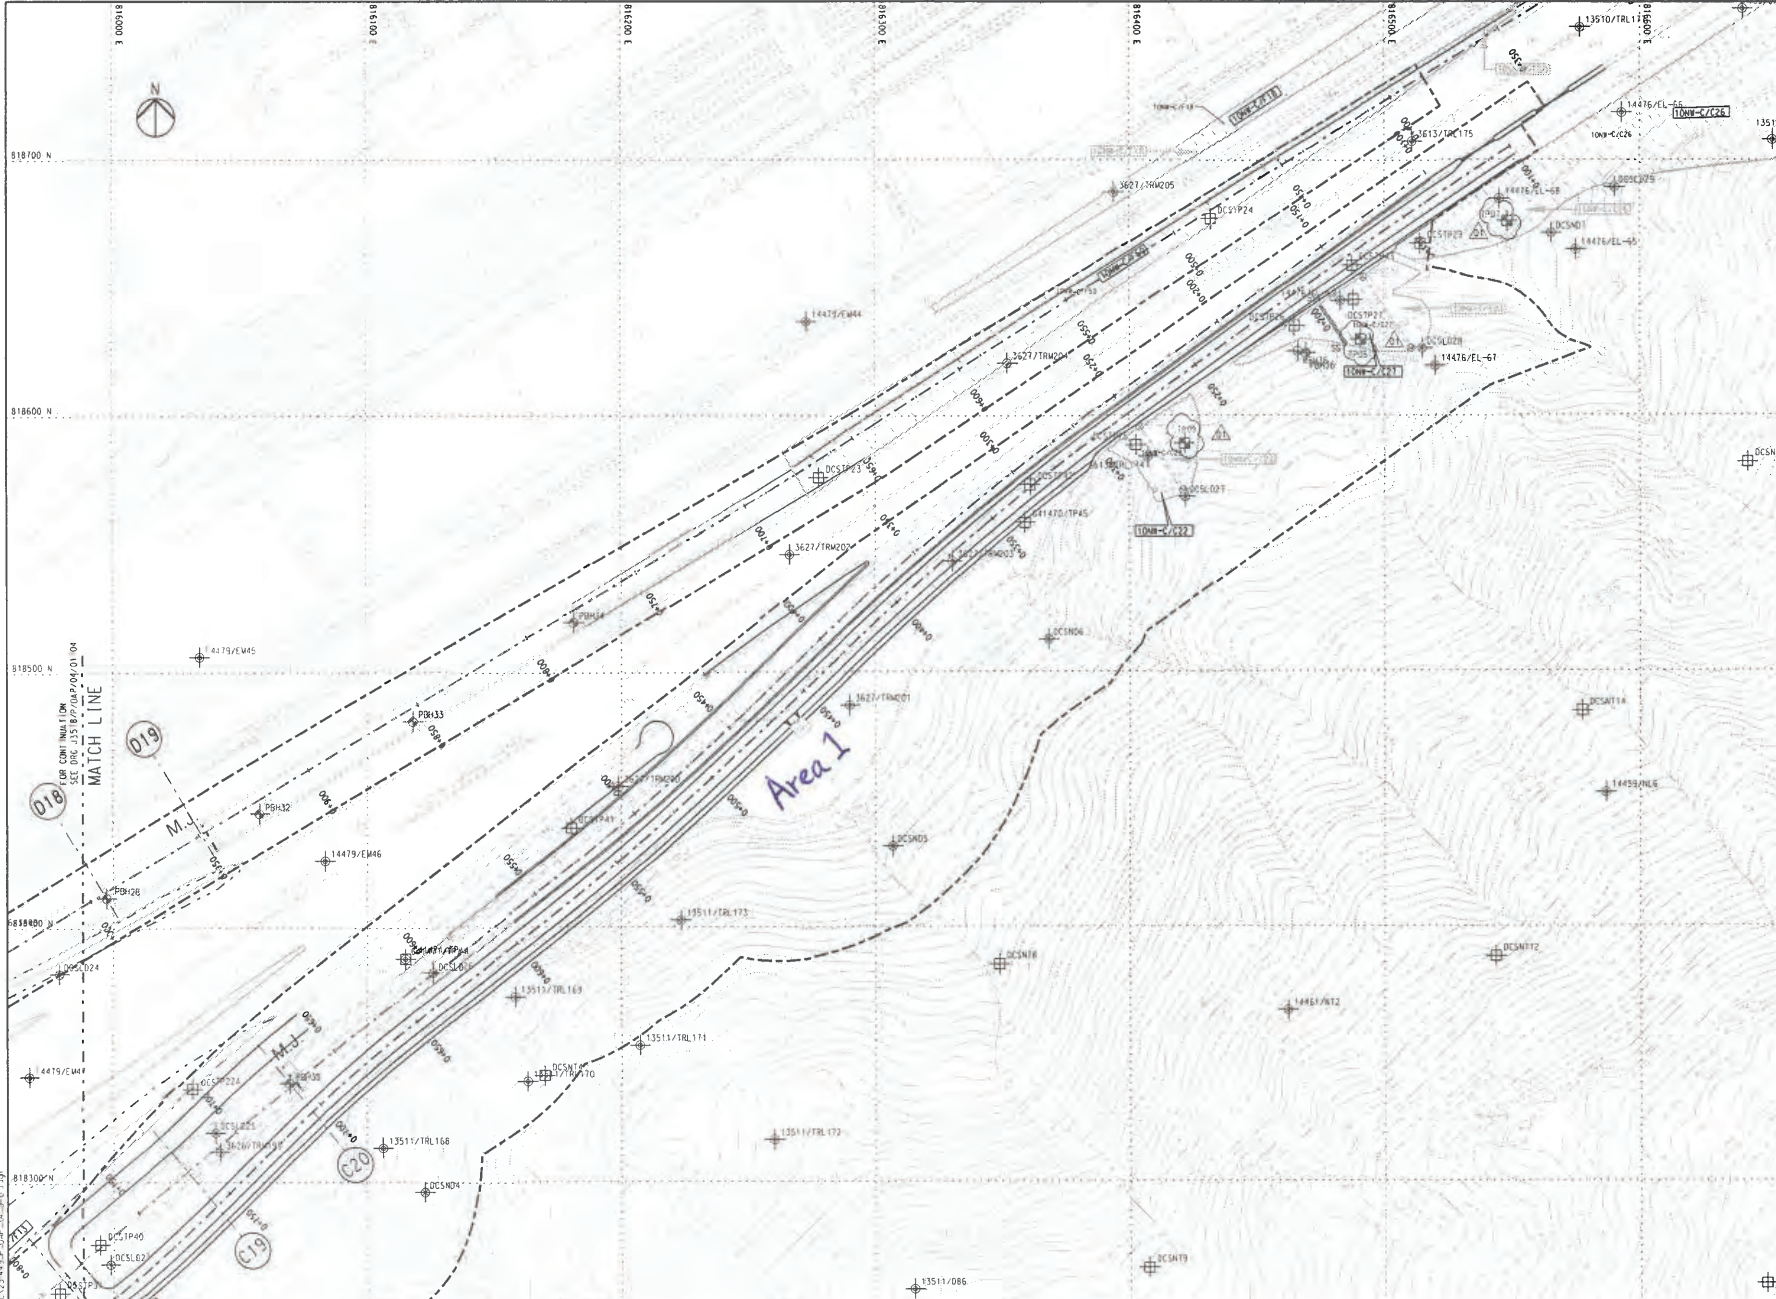

**NOTES**  
 THIS DRAWING SHALL BE READ IN CONJUNCTION WITH DRAWING NO. J3518/P/OAP/04/1000 AND OTHER RELEVANT DRAWINGS.

- LEGEND**
- SITE BOUNDARY
  - GF1 FAULT
- EXISTING G.I. STATIONS :
- ⊕ BOREHOLE BY GIU DATA EXCLUDING VC
  - ⊕ BOREHOLE BY GCL CONTRACT HY/2012/04
  - ⊕ BOREHOLE BY GCL CONTRACT N6.8/97
  - ⊕ BOREHOLE BY GCL CONTRACT HY/2009/23
  - ⊕ TRIAL PIT BY GCL CONTRACT HY/2012/04
  - ⊕ SLOPE STRIPPING BY GCL CONTRACT HY/2012/04
- PROPOSED G.I. STATIONS :
- ⊕ B-0 PROPOSED BOREHOLE
  - ⊕ T-0 PROPOSED TRIAL PIT
  - ⊕ C-01 PROPOSED COREHOLE
  - ⊕ S502 PROPOSED SLOPE STRIPPING

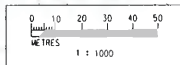

Rev	Description	By	Date	Rev	Description	By	Date
01	FOR CONSTRUCTION	RL	31/7/13				
02	FOR CONSTRUCTION	RL	27/7/13				
03	FOR CONSTRUCTION	RL	29/7/13				
04	FOR INTERNAL REVIEW	RL	19/7/12				

Drawn	Date	Client
RL	07/13	路政署 HIGHWAYS DEPARTMENT 港珠澳大桥香港工程指挥部 Hong Kong - Zhuhai - Macao Bridge Hong Kong Project Management Office
Checked	Approved	
DS	DOP	
Scale		

Scale: 1:1000 @ A1 / 1:2000 @ A3

	Project Title Contract No. HY/2012/07 Tuen Mun - Chek Lap Kok Link Southern Connection Viaduct Section
	Drawing title <b>Figure 1.2k</b>
Supervising Officer 	Contractor 
Originator 	Drawing no. J3518/P/OAP/04/01105 Rev. D1

1:1000 @ A1 / 1:2000 @ A3  
 1:1000 @ A1 / 1:2000 @ A3



**Table 1.1** *Contact Information of Key Personnel*

<b>Party</b>	<b>Position</b>	<b>Name</b>	<b>Telephone</b>	<b>Fax</b>
HyD (Highways Department)	Project Coordinator	Stanley Chan	2762 3406	3188 6614
	Senior Engineer	Steven Shum	2762 4133	3188 6614
SOR (AECOM Asia Company Limited)	Chief Resident Engineer	Daniel Ip	3553 3800	2492 2057
	Resident Engineer	Kingman Chan	3691 3950	3691 2899
ENPO / IEC (Ramboll Hong Kong Ltd.)	ENPO Leader	Y.H. Hui	3465 2850	3465 2899
	IEC	Dr. F.C. Tsang	3465 2851	3465 2899
Contractor (Gammon Construction Limited)	Environmental Officer	Roy Leung	3520 0387	3520 0486
	24-hour Complaint Hotline		9738 4332	
ET (ERM-HK)	ET Leader	Dr. Jasmine Ng	2271 3311	2723 5660

#### **1.4** *SUMMARY OF CONSTRUCTION WORKS*

The construction phase of the Contract commenced on 31 October 2013. The three-month rolling construction programme is shown in Appendix B.

As informed by the Contractor, details of the major works carried out in this reporting month are listed below:

##### ***Land-based Works***


- Pier construction;
- Re-alignment of Cheung Tung Road;
- Road works along North Lantau Highway;
- Installation of pier head and deck segments;
- Asphalt paving;
- Construction of sign gantries, light poles and street furniture;
- Parapets and barriers installation; and
- Slope work of Viaducts A, B, C & D.

The locations of the construction activities are shown in *Figure 1.3*. The Environmental Sensitive Receivers in the vicinity of the Project are shown in *Figure 1.4*.



The environmental mitigation measures implementation schedule is presented in *Appendix C*.

Figure 1.3 Locations of Major Construction Activities in the Reporting Month

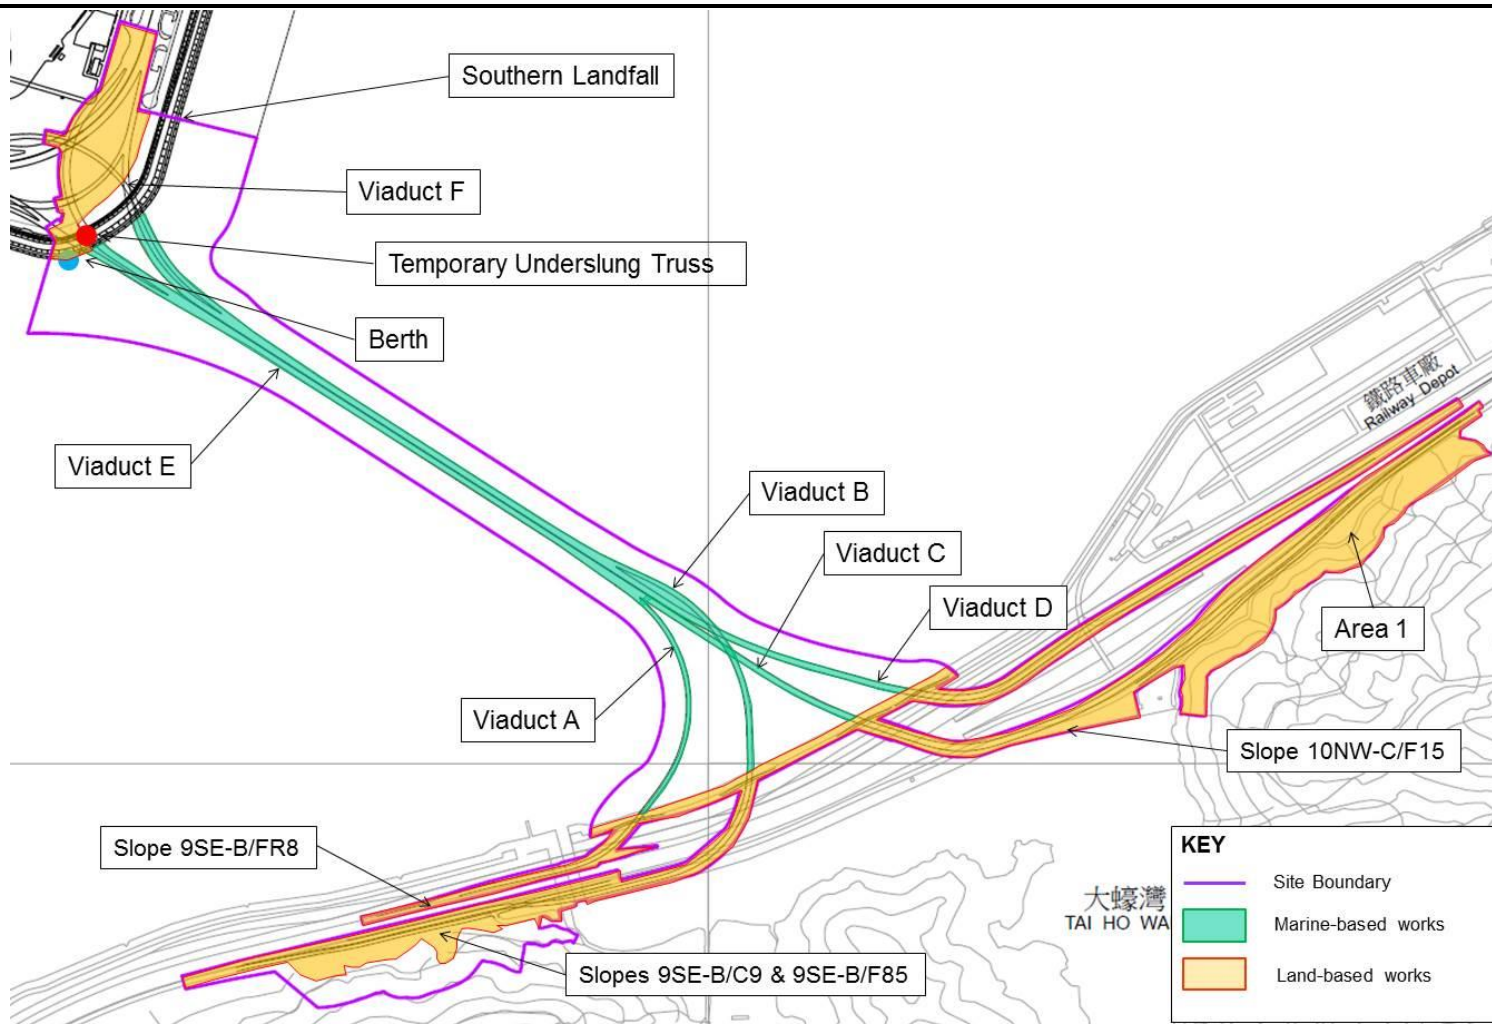

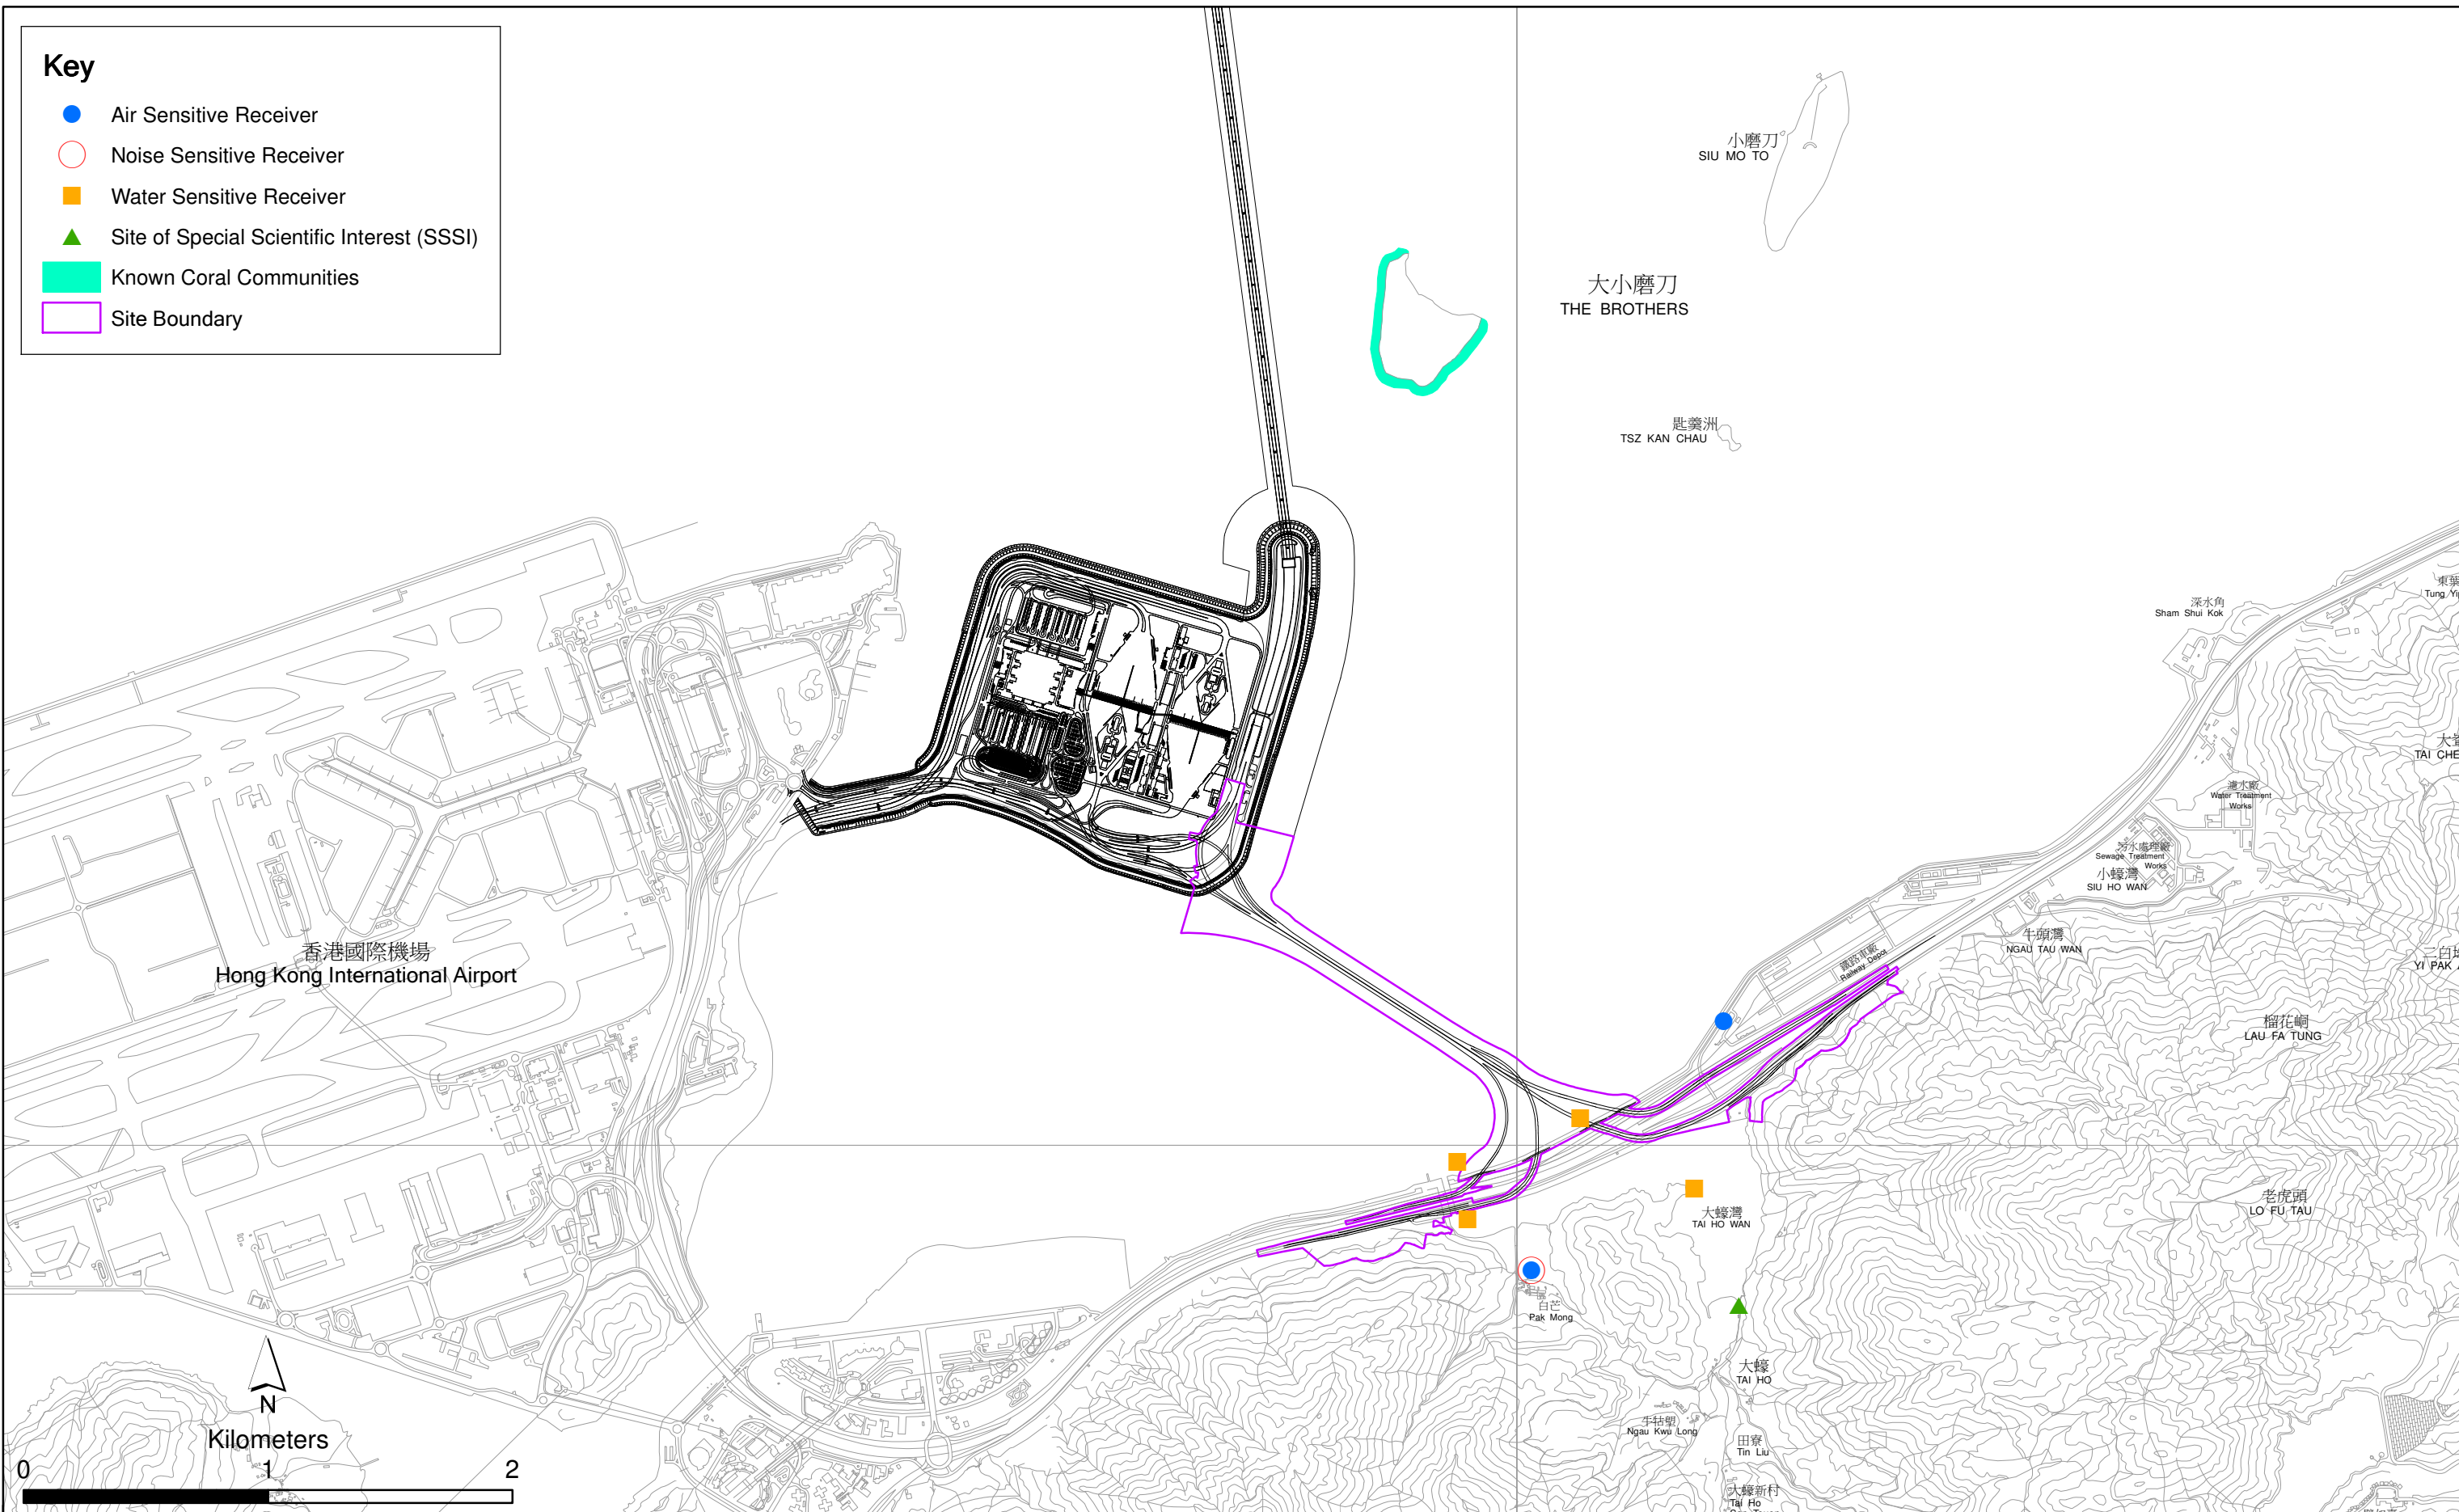


Figure 1.4

Environmental Sensitive Receivers in the Vicinity of Contract No. HY/2012/07  
Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section

The EM&A programme required environmental monitoring for air quality, noise, water quality and marine ecology as well as environmental site inspections for air quality, noise, water quality, waste management, marine ecology and landscape and visual impacts. The EM&A requirements and related findings for each component are summarized in the following sections.

## 2.1 AIR QUALITY

### 2.1.1 Monitoring Requirements and Equipment

In accordance with the Updated EM&A Manual, impact 1-hour TSP monitoring was conducted three (3) times every six (6) days and impact 24-hour TSP monitoring was carried out once every six (6) days when the highest dust impact was expected. The Action and Limit Levels of the air quality monitoring is provided in *Appendix D*.

**Table 2.1** *Locations of Impact Air Quality Monitoring Stations*

Monitoring Station	Location	Description	Monitoring Dates
ASR 9	MTR Depot	On the ground nearby MTR Depot Entrance	3, 9, 12, 18, 24 and 30 July 2018
ASR 8A	Area 4	On ground at the works area, Area 4	3, 9, 12, 18, 24 and 30 July 2018

High Volume Samplers (HVSs) were used for 1-hour TSP and 24-hour TSP monitoring at ASR8A and ASR9 in accordance with the requirements of the Updated EM&A Manual. The TSP monitoring stations are illustrated in *Figure 2.1* and detailed in *Table 2.1*. Wind meter was deployed at Area 4 for logging wind speed and wind direction. Copies of the calibration certificates for the equipment are presented in *Appendix E*. Details of the deployed equipment are given in *Table 2.2*.

**Key**

- Alternative Air Monitoring Station
- Site Boundary

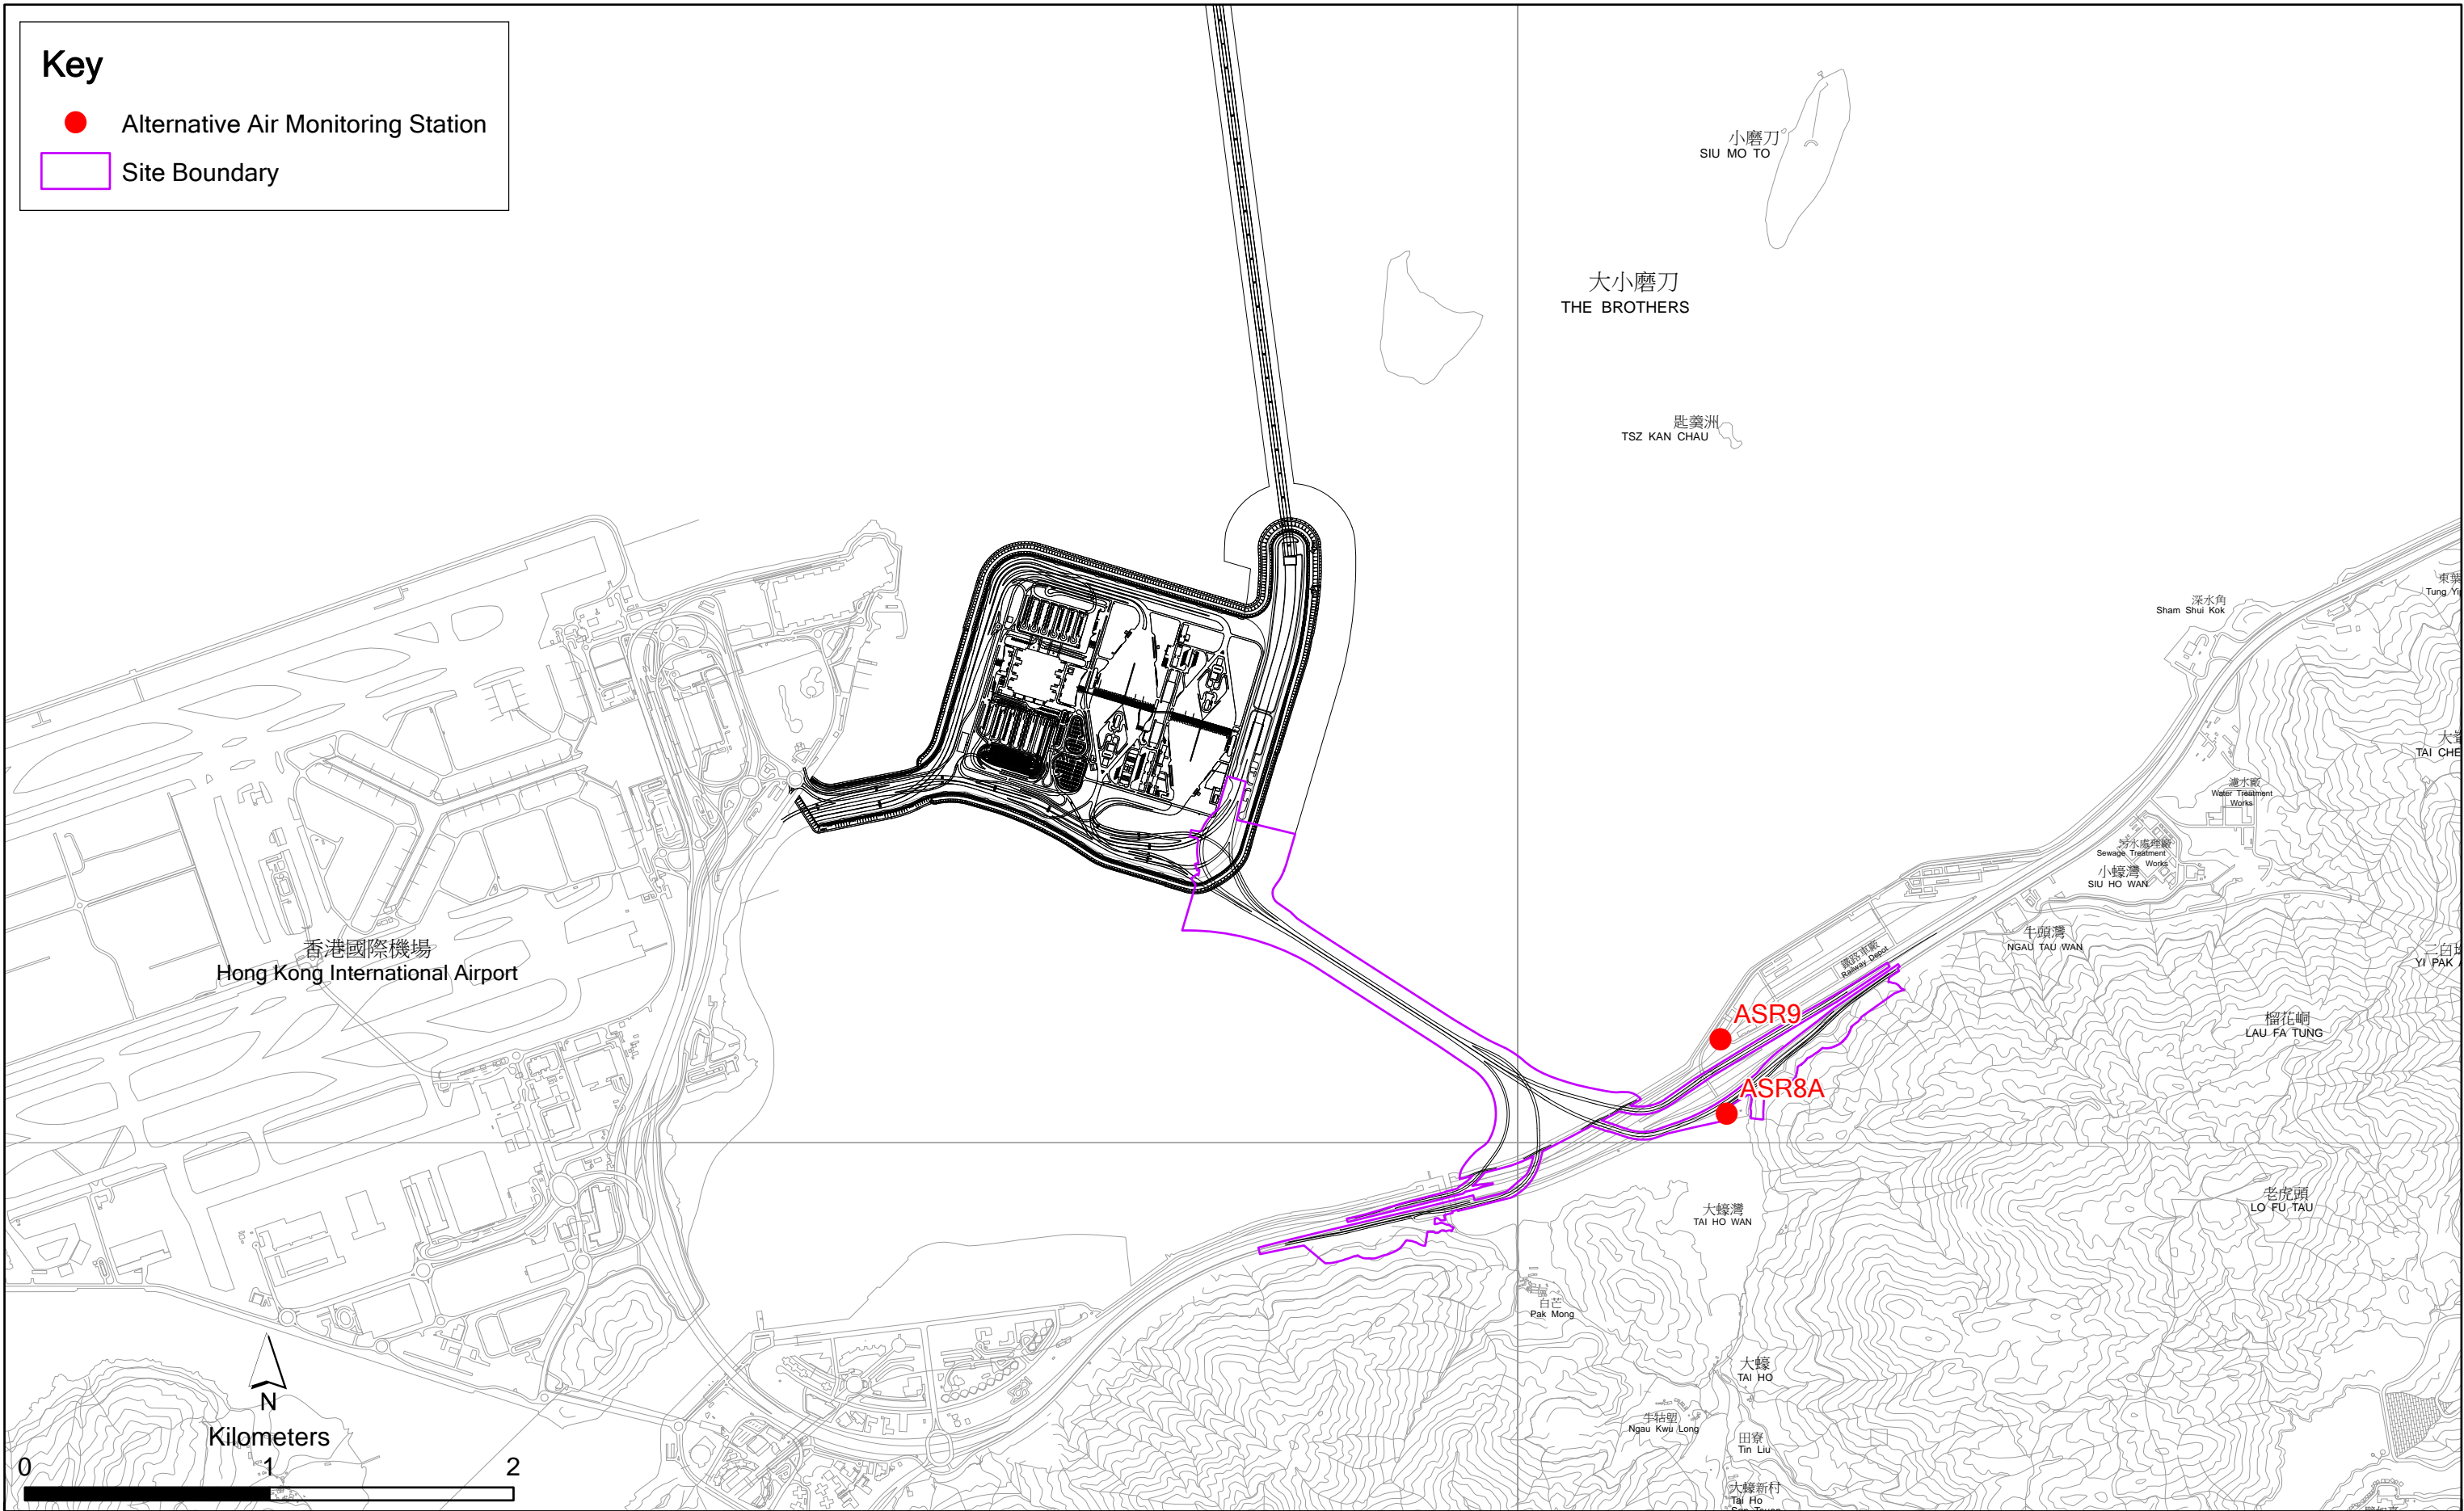


Figure 2.1

Locations of Air Quality Monitoring Stations

**Table 2.2 Air Quality Monitoring Equipment**

<b>Equipment</b>	<b>Brand and Model</b>
High Volume Sampler (1-hour TSP and 24-hour TSP)	Tisch Environmental Mass Flow Controlled Total Suspended Particulate (TSP) High Volume Sampler (Model No. TE-5170)
Wind Sensor	Global Water (Wind Speed Sensor: WE550; Wind Direction Sensor: WE570)
Wind Anemometer for calibration	Lutron (Model No. AM-4201)

**2.1.2 Monitoring Schedule for the Reporting Month**

The schedule for air quality monitoring in July 2018 is provided in *Appendix F*.

**2.1.3 Results and Observations**

The monitoring results for 1-hour TSP and 24-hour TSP are summarized in *Tables 2.3 and 2.4* respectively. Detailed impact air quality monitoring results are presented in *Appendix G*.

**Table 2.3 Summary of 1-hour TSP Monitoring Results in the Reporting Period**

<b>Monitoring Station</b>	<b>Average (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Range (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Action Level (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Limit Level (<math>\mu\text{g}/\text{m}^3</math>)</b>
ASR 8A	48	19-78	394	500
ASR 9	53	17-108	393	500

**Table 2.4 Summary of 24-hour TSP Monitoring Results in the Reporting Period**

<b>Monitoring Station</b>	<b>Average (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Range (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Action Level (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Limit Level (<math>\mu\text{g}/\text{m}^3</math>)</b>
ASR 8A	28	18-32	178	260
ASR 9	31	21-44	178	260

The major dust sources in the reporting period included construction activities under the Contract as well as nearby traffic emissions.

All 1-hour and 24-hour TSP results were below the Action and Limit Levels at all monitoring locations in the reporting period. No action is thus required to be undertaken in accordance with the Event Action Plan presented in *Appendix L*.

Meteorological information collected at ASR8A including wind speed and wind direction is provided in *Appendix H*.

## 2.2 NOISE MONITORING

### 2.2.1 Monitoring Requirements and Equipment

In accordance with the Updated EM&A Manual, impact noise monitoring was conducted once per week during the construction phase of the Contract. The Action and Limit Level of the noise monitoring is provided in *Appendix D*.

Noise monitoring was performed on 3, 9, 12, 18, 24 and 30 July 2018 using sound level meter at the designated monitoring station NSR1A (*Figure 2.2; Table 2.5*) in accordance with the requirements stipulated in the Updated EM&A Manual. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Details of the deployed equipment are provided in *Table 2.6*. Copies of the calibration certificates for the equipment are presented in *Appendix E*.

**Table 2.5** *Location of Impact Noise Monitoring Station*

Monitoring Station	Location	Description	Parameter	Frequency and Duration	Monitoring Dates
NSR 1A	Pak Mong Village Pavilion	On the ground at the village entrance	30-minute measurement at each monitoring station between 0700 and 1900 on normal weekdays (Monday to Saturday). $L_{eq}$ , $L_{10}$ and $L_{90}$ would be recorded.	At least once per week	3, 9, 12, 18, 24 and 30 July 2018

**Table 2.6** *Noise Monitoring Equipment*

Equipment	Brand and Model
Integrated Sound Level Meter	Rion NL-52
Acoustic Calibrator	Rion NC-73

### 2.2.2 Monitoring Schedule for the Reporting Month

The schedule for construction noise monitoring in the reporting period is provided in *Appendix F*.

### 2.2.3 Results and Observations

Results for noise monitoring are summarized in *Table 2.7* and the monitoring data is provided in *Appendix I*.

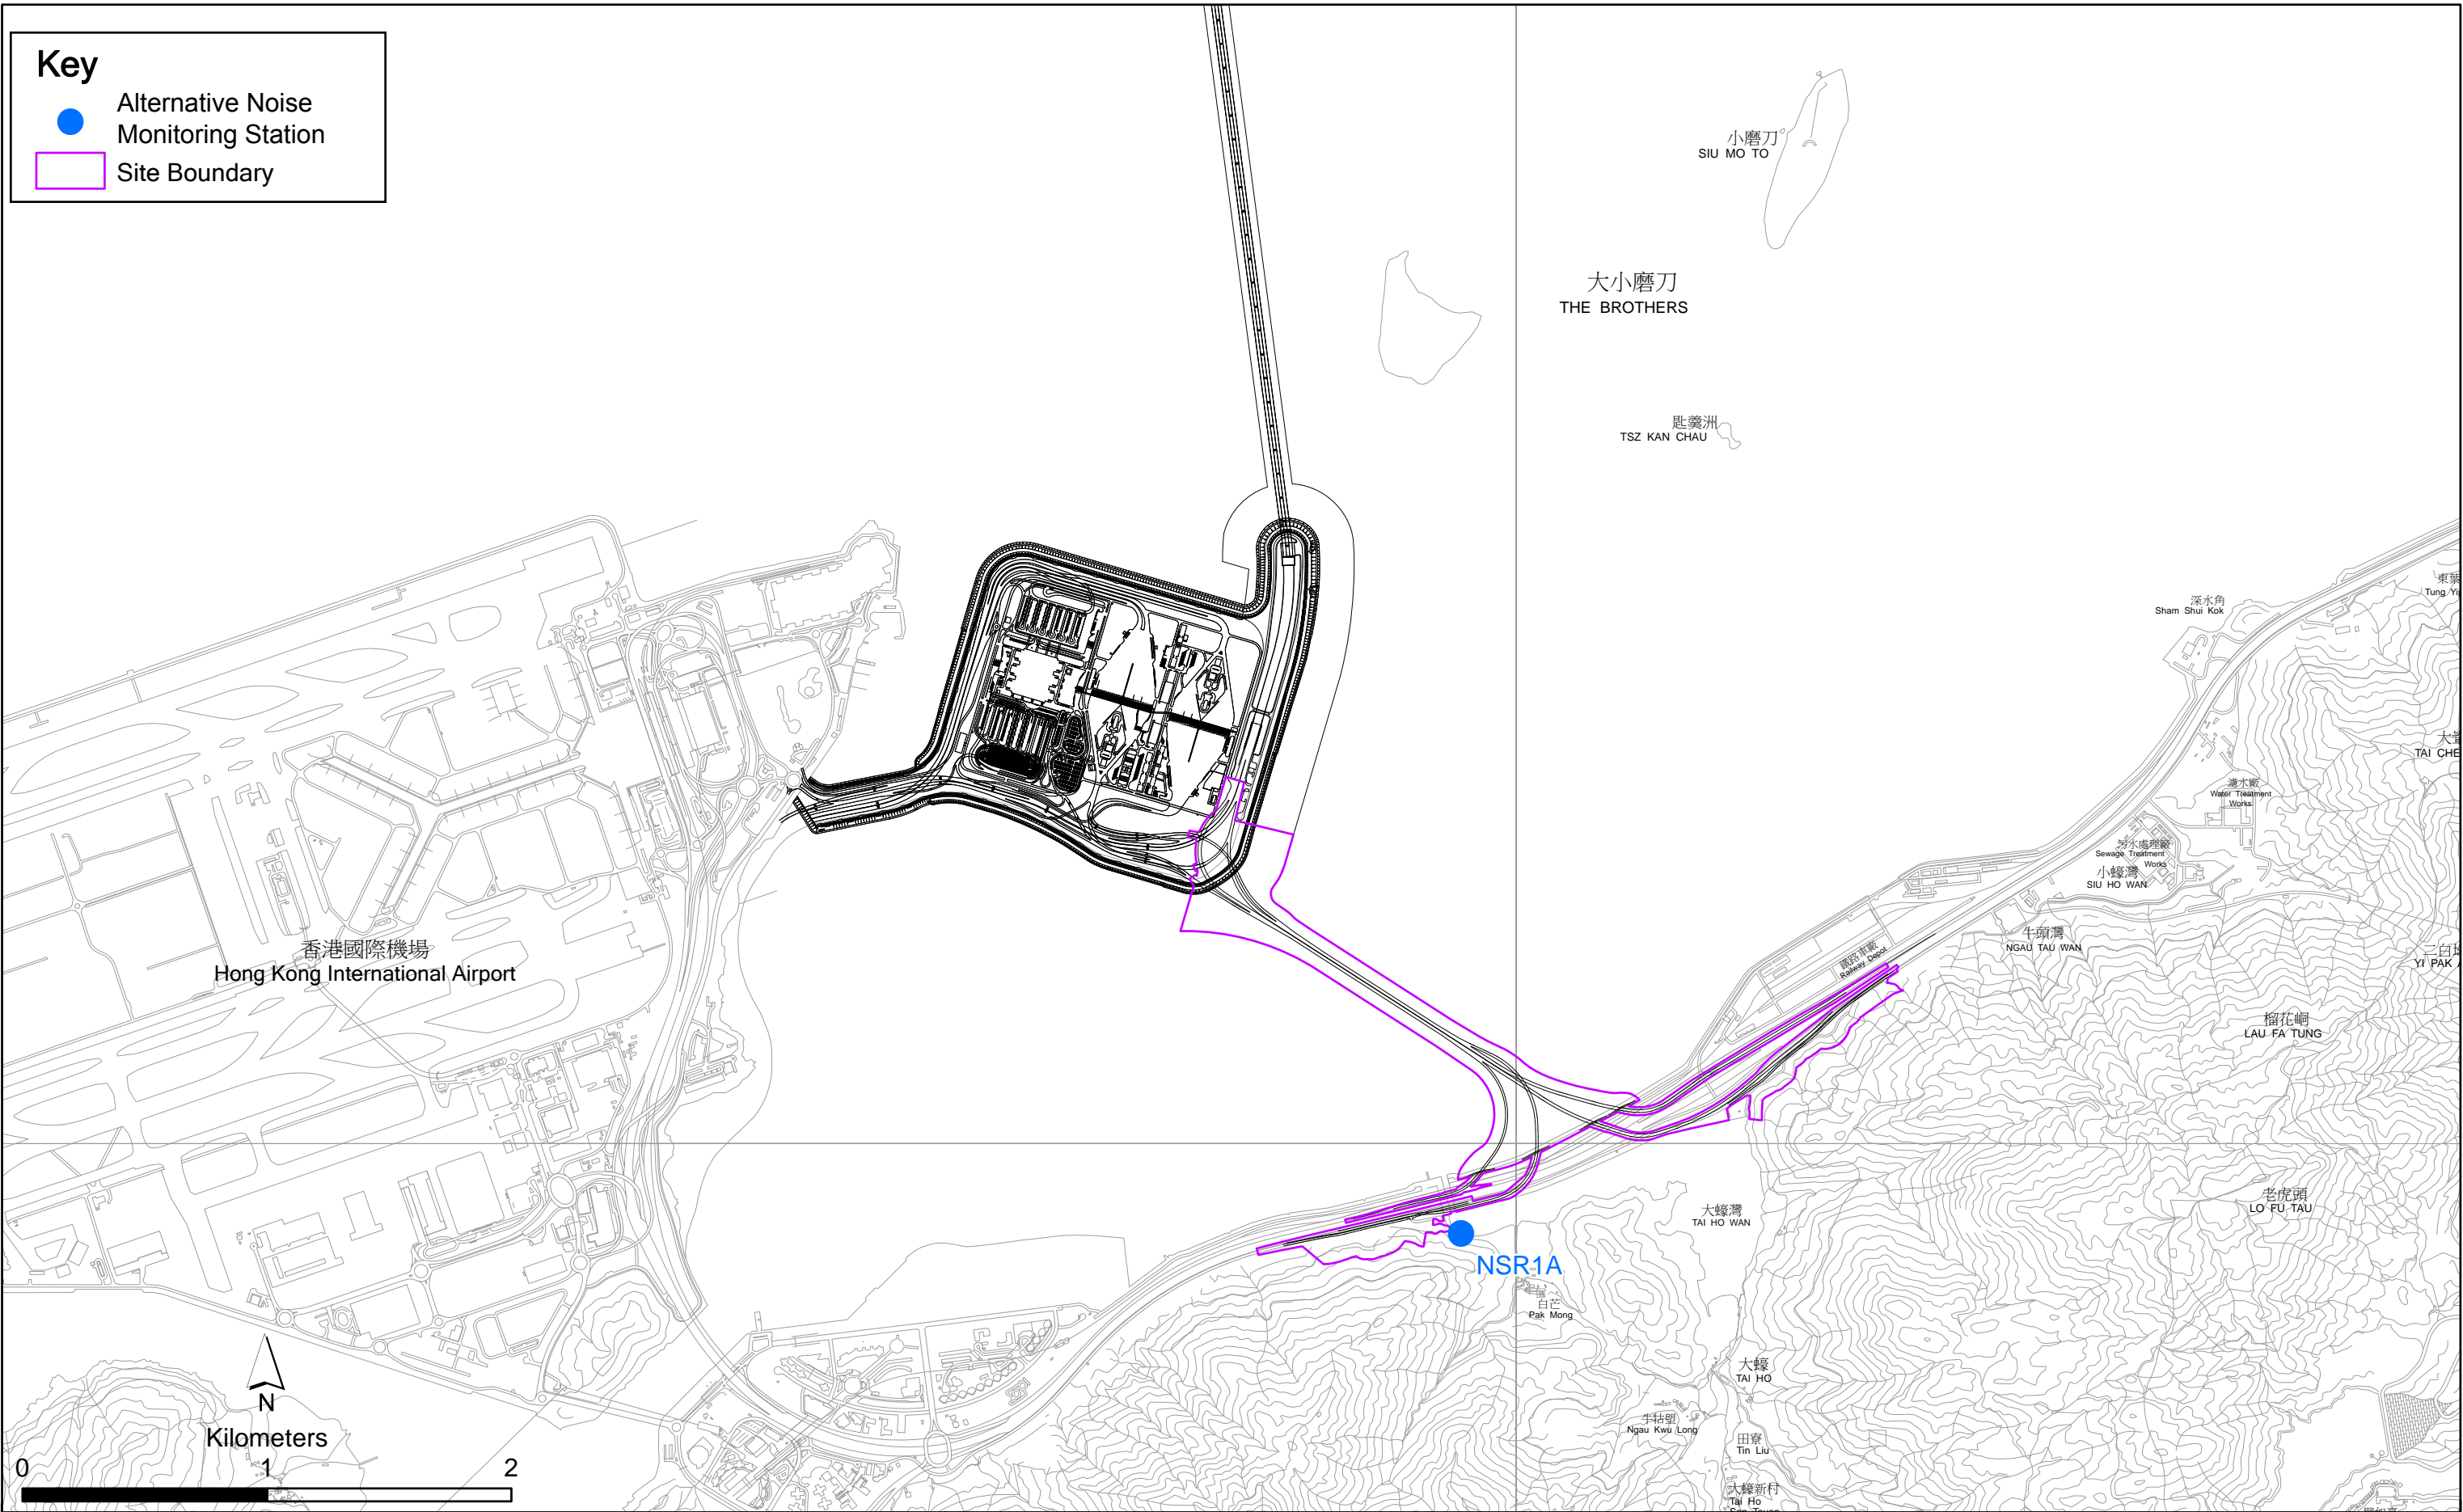


Figure 2.2

Location of Noise Monitoring Station



**Table 2.7 Summary of Construction Noise Monitoring Results in the Reporting Period**

	Average, dB(A), Leq (30mins)	Range, dB(A), Leq (30mins)	Limit Level, dB(A), Leq (30mins)
NSR 1A	64	62-65	75

Major noise sources during the noise monitoring included noise from crane and rock breaking activities, and nearby traffic noise and aircraft noise.

**2.3 WATER QUALITY MONITORING**

**2.3.1 Monitoring Requirements and Equipment**

Impact water quality monitoring was carried out to ensure that any deterioration of water quality was detected, and that timely action was taken to rectify the situation. Impact water quality monitoring was undertaken three days per week during the construction period in accordance with the Updated EM&A Manual. The Action and Limit Levels of the water quality monitoring are provided in *Appendix D*.

The locations of the monitoring stations under the Contract are shown in *Figure 2.3* and *Table 2.8*.

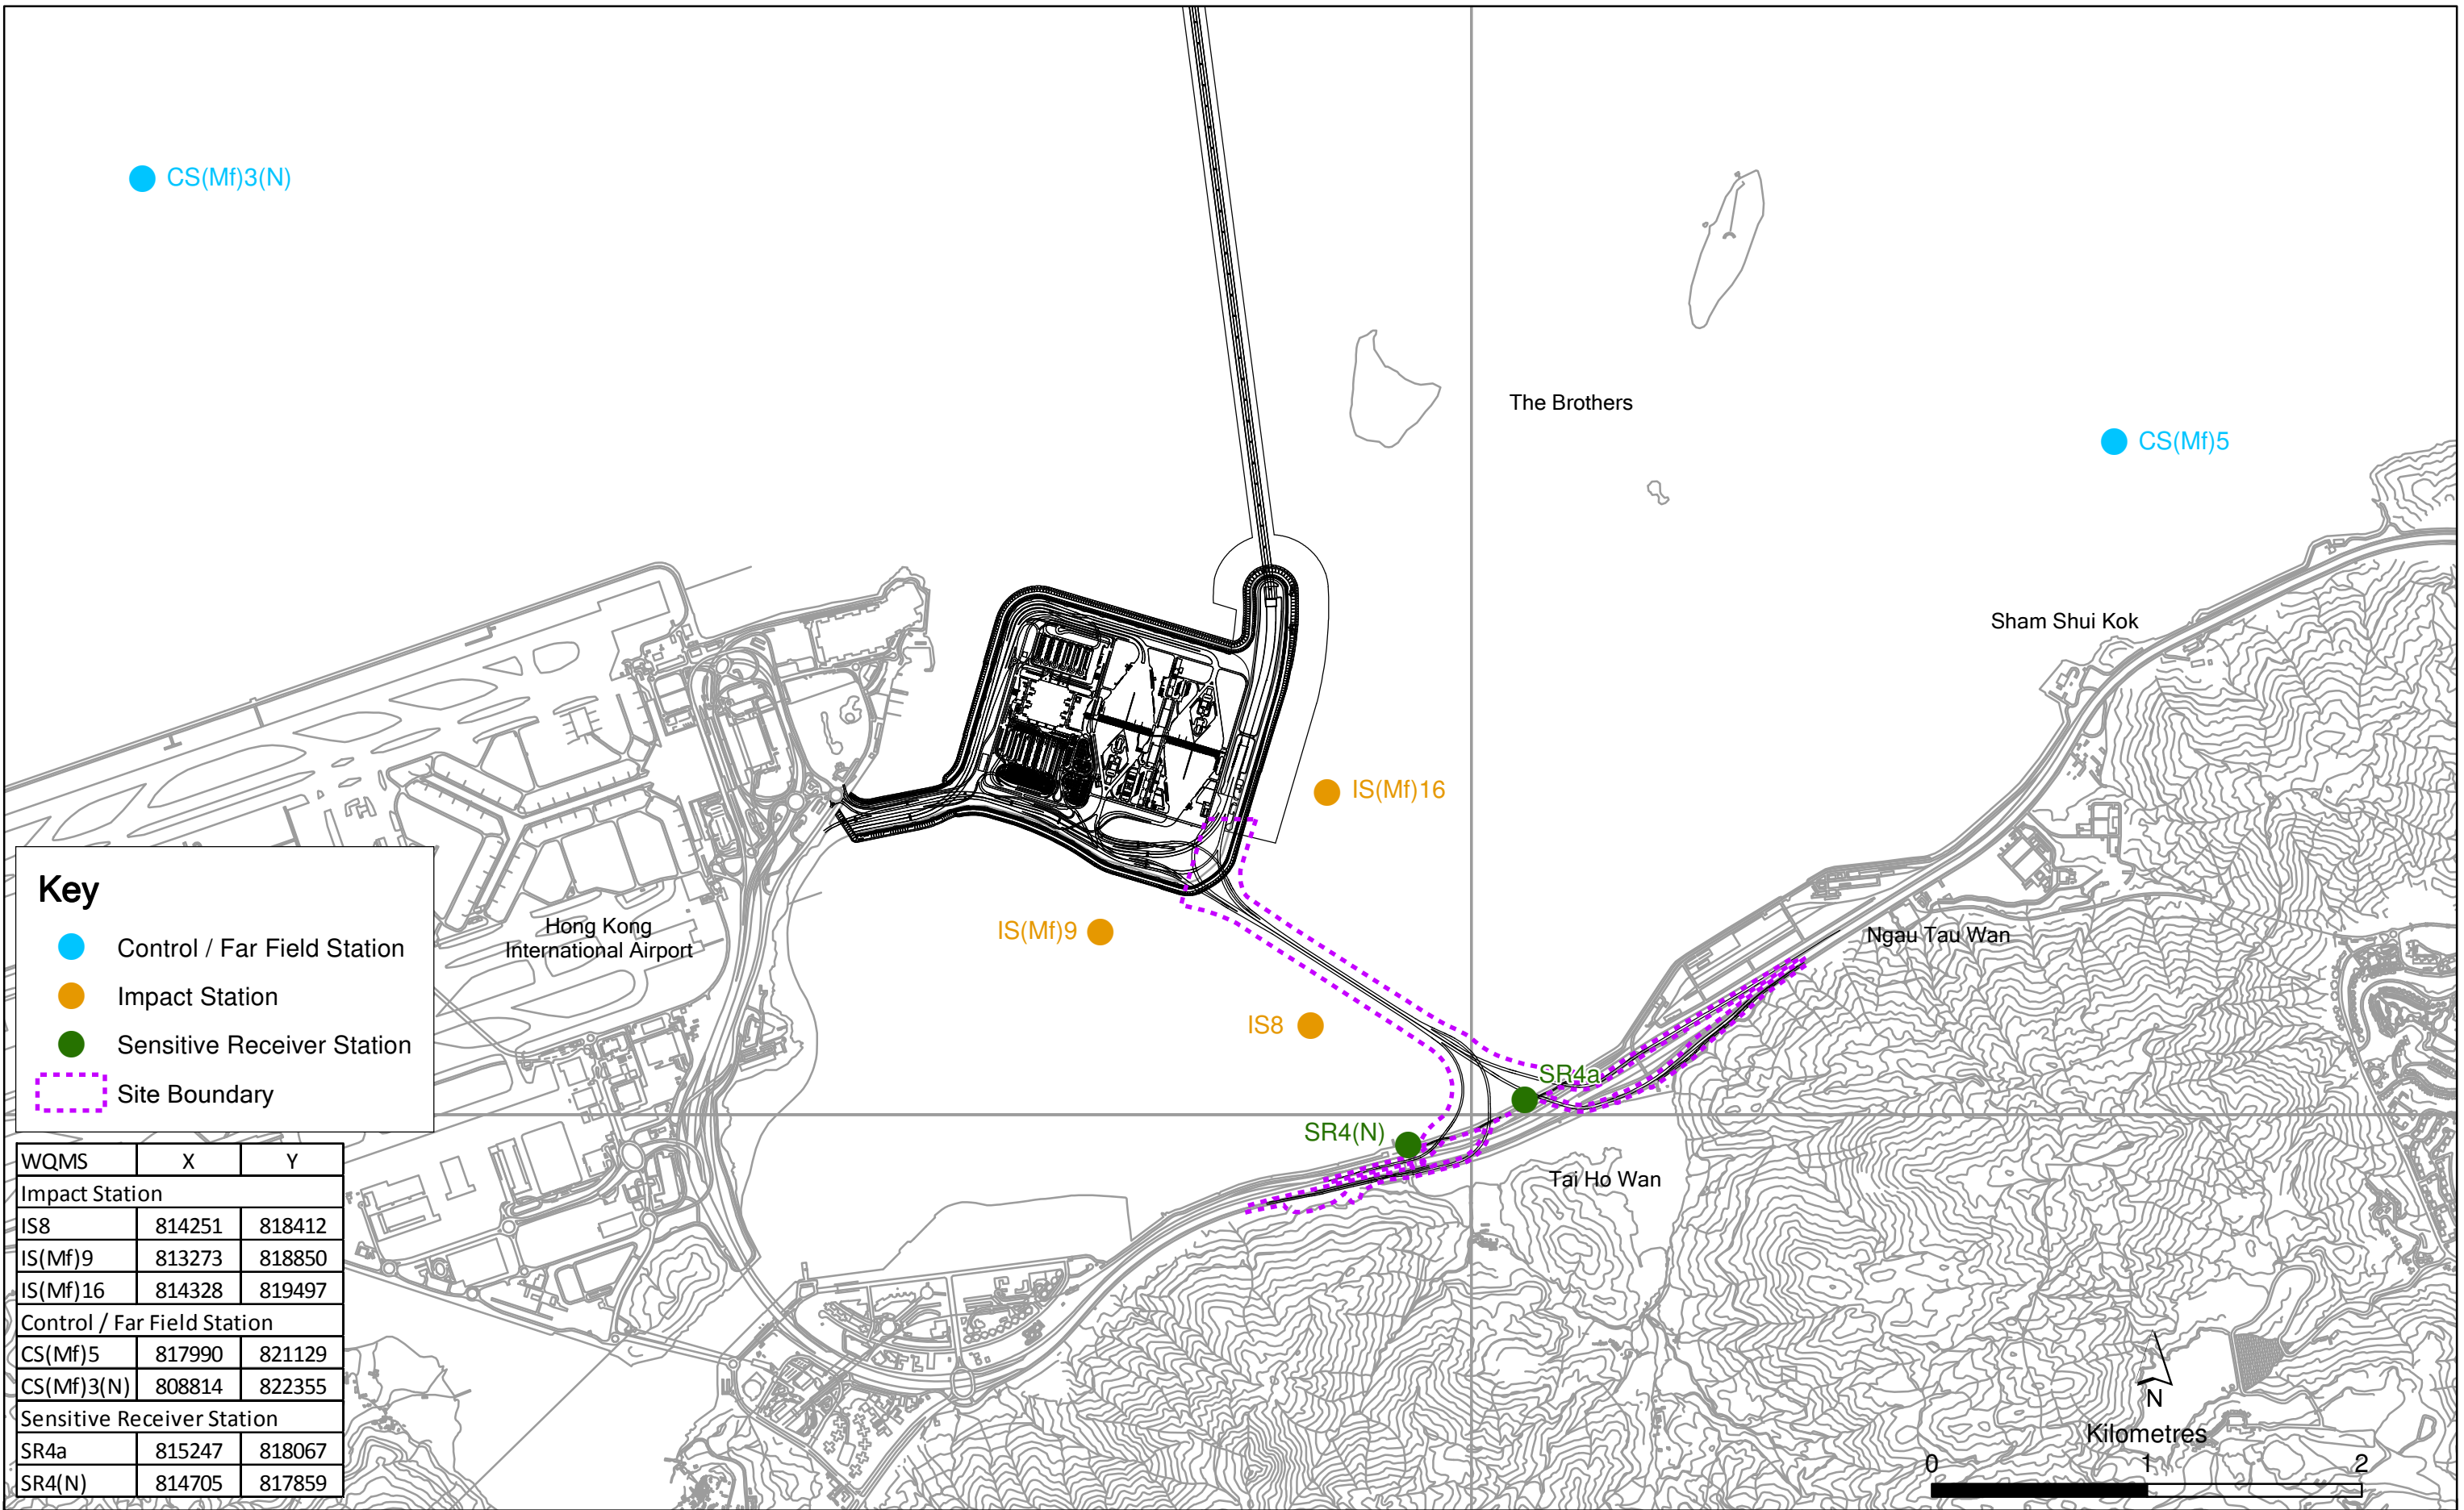


Figure 2.3

Locations of Water Quality Monitoring Stations

**Table 2.8 Locations of Impact Water Quality Monitoring Stations and its Corresponding Monitoring Requirements**

Station ID	Type	Coordinates		*Parameters, unit	Frequency	Depth
		Easting	Northing			
IS(Mf)9	Impact Station (Close to HKBCF construction site)	813273	818850	<ul style="list-style-type: none"> <li>• Temperature(°C)</li> <li>• pH (pH unit)</li> <li>• Turbidity (NTU)</li> </ul>	Impact monitoring: 3 days per week, at mid-flood and mid-ebb tides during the construction period of the Contract	3 water depths: 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted
IS(Mf)16	Impact Station (Close to HKBCF construction site)	814328	819497			
IS8	Impact Station (Close to HKBCF construction site)	814251	818412			
SR4(N)	Sensitive receiver (Tai Ho Inlet)	814705	817859	<ul style="list-style-type: none"> <li>• Suspended Solid (SS) (mg/L)</li> </ul>		
SR4a	Sensitive receiver	815247	818067			
CS(Mf)3(N)	Control Station	808814	822355			
CS(Mf)5	Control Station	817990	821129			

\*Notes:

In addition to the parameters presented monitoring location/position, time, water depth, sampling depth, tidal stages, weather conditions and any special phenomena or works underway nearby were also recorded.

Water Quality Monitoring Station CS(Mf)3 was relocated to CS(Mf)3(N) since 2 May 2017.

Water Quality Monitoring Station SR4 was relocated to SR4(N) since 2 March 2018.

Table 2.9 summarises the equipment used in the impact water quality monitoring programme. Copies of the calibration certificates are attached in Appendix E.

**Table 2.9 Water Quality Monitoring Equipment**

Equipment	Brand and Model
Multi-parameters (Dissolved Oxygen, Salinity, Turbidity, Temperature, pH)	YSI ProDSS / YSI 6920 V2
Positioning Equipment	Furuno GP-170
Water Depth Detector	Lowrance Mark 5x / Garmin Striker 4
Water Sampler	WildCo Vertical Alpha Bottles 1120-2.2L /1120-3.2L Aquatic Research Instrument Vertical/Horizontal Point Water Sampler 2.2L / 3.0L

### 2.3.2 *Monitoring Schedule for the Reporting Month*

The schedule for water quality monitoring in July 2018 is provided in *Appendix F*. Water quality monitoring during mid-flood tide at all water quality monitoring stations on 18 July 2018 was cancelled due to adverse weather.

### 2.3.3 *Results and Observations*

In total of 13 monitoring events for impact water quality monitoring were conducted at all designated monitoring stations in the reporting month. Impact water quality monitoring results and graphical presentations are provided in *Appendix J*.

Four (4) Action Level and one (1) Limit Level of Dissolved Oxygen (DO) exceedances and one (1) Limit Level of Suspended Solids exceedance were recorded for water quality impact monitoring in the reporting month. The exceedances were considered not related to this Contract upon further investigation and the investigation report is presented in *Appendix N*. No action is required to be undertaken in accordance with the Event Action Plan as presented in *Appendix L*.

## 2.4 *DOLPHIN MONITORING*

### 2.4.1 *Monitoring Requirements*

Impact dolphin monitoring is required to be conducted by a qualified dolphin specialist team to evaluate whether there have been any effects on the Indo-Pacific humpback dolphin *Sousa chinensis* (i.e. Chinese White Dolphin) from the Contract. In order to fulfil the EM&A requirements and make good use of available resources, the on-going impact line transect dolphin monitoring data collected by HyD's *Contract No. HY/2011/03 Hong Kong-Zhuhai-Macao Bridge, Hong Kong Link Road - Section between Scenic Hill and Hong Kong Boundary Crossing Facilities* on the monthly basis is adopted to avoid duplicates of survey effort.

### 2.4.2 *Monitoring Equipment*

*Table 2.10* summarizes the equipment used for the impact dolphin monitoring.

**Table 2.10** *Dolphin Monitoring Equipment*

<b>Equipment</b>	<b>Model</b>
Global Positioning System (GPS)	Garmin 18X-PC Geo One Phottix
Camera	Nikon D90 300m 2.8D fixed focus Nikon D90 20-300m zoom lens
Laser Binoculars	Infinitor LRF 1000
Marine Binocular	Bushell 7 × 50 marine binocular with compass and reticules
Vessel for Monitoring	65 foot single engine motor vessel with viewing platform 4.5m above water level

### 2.4.3 *Monitoring Parameter, Frequencies and Duration*

Dolphin monitoring should cover all transect lines in Northeast Lantau (NEL) and the Northwest Lantau (NWL) survey areas twice per month throughout the entire construction period. The monitoring data should be compatible with, and should be made available for, long-term studies of small cetacean ecology in Hong Kong. In order to provide a suitable long-term dataset for comparison, identical methodology and line transects employed in baseline dolphin monitoring was followed in the impact dolphin monitoring.

### 2.4.4 *Monitoring Location*

The impact dolphin monitoring was carried out in the NEL and NWL along the line transect as depicted in *Figure 2.4*. The co-ordinates of all transect lines are shown in *Table 2.11* below <sup>(1)</sup>.

<sup>(1)</sup> Proposal on the changes of transect lines for dolphin monitoring was approved by EPD on 28 July 2017 (Reference number: (19) in EP2/G/A/129 Pt. 8).

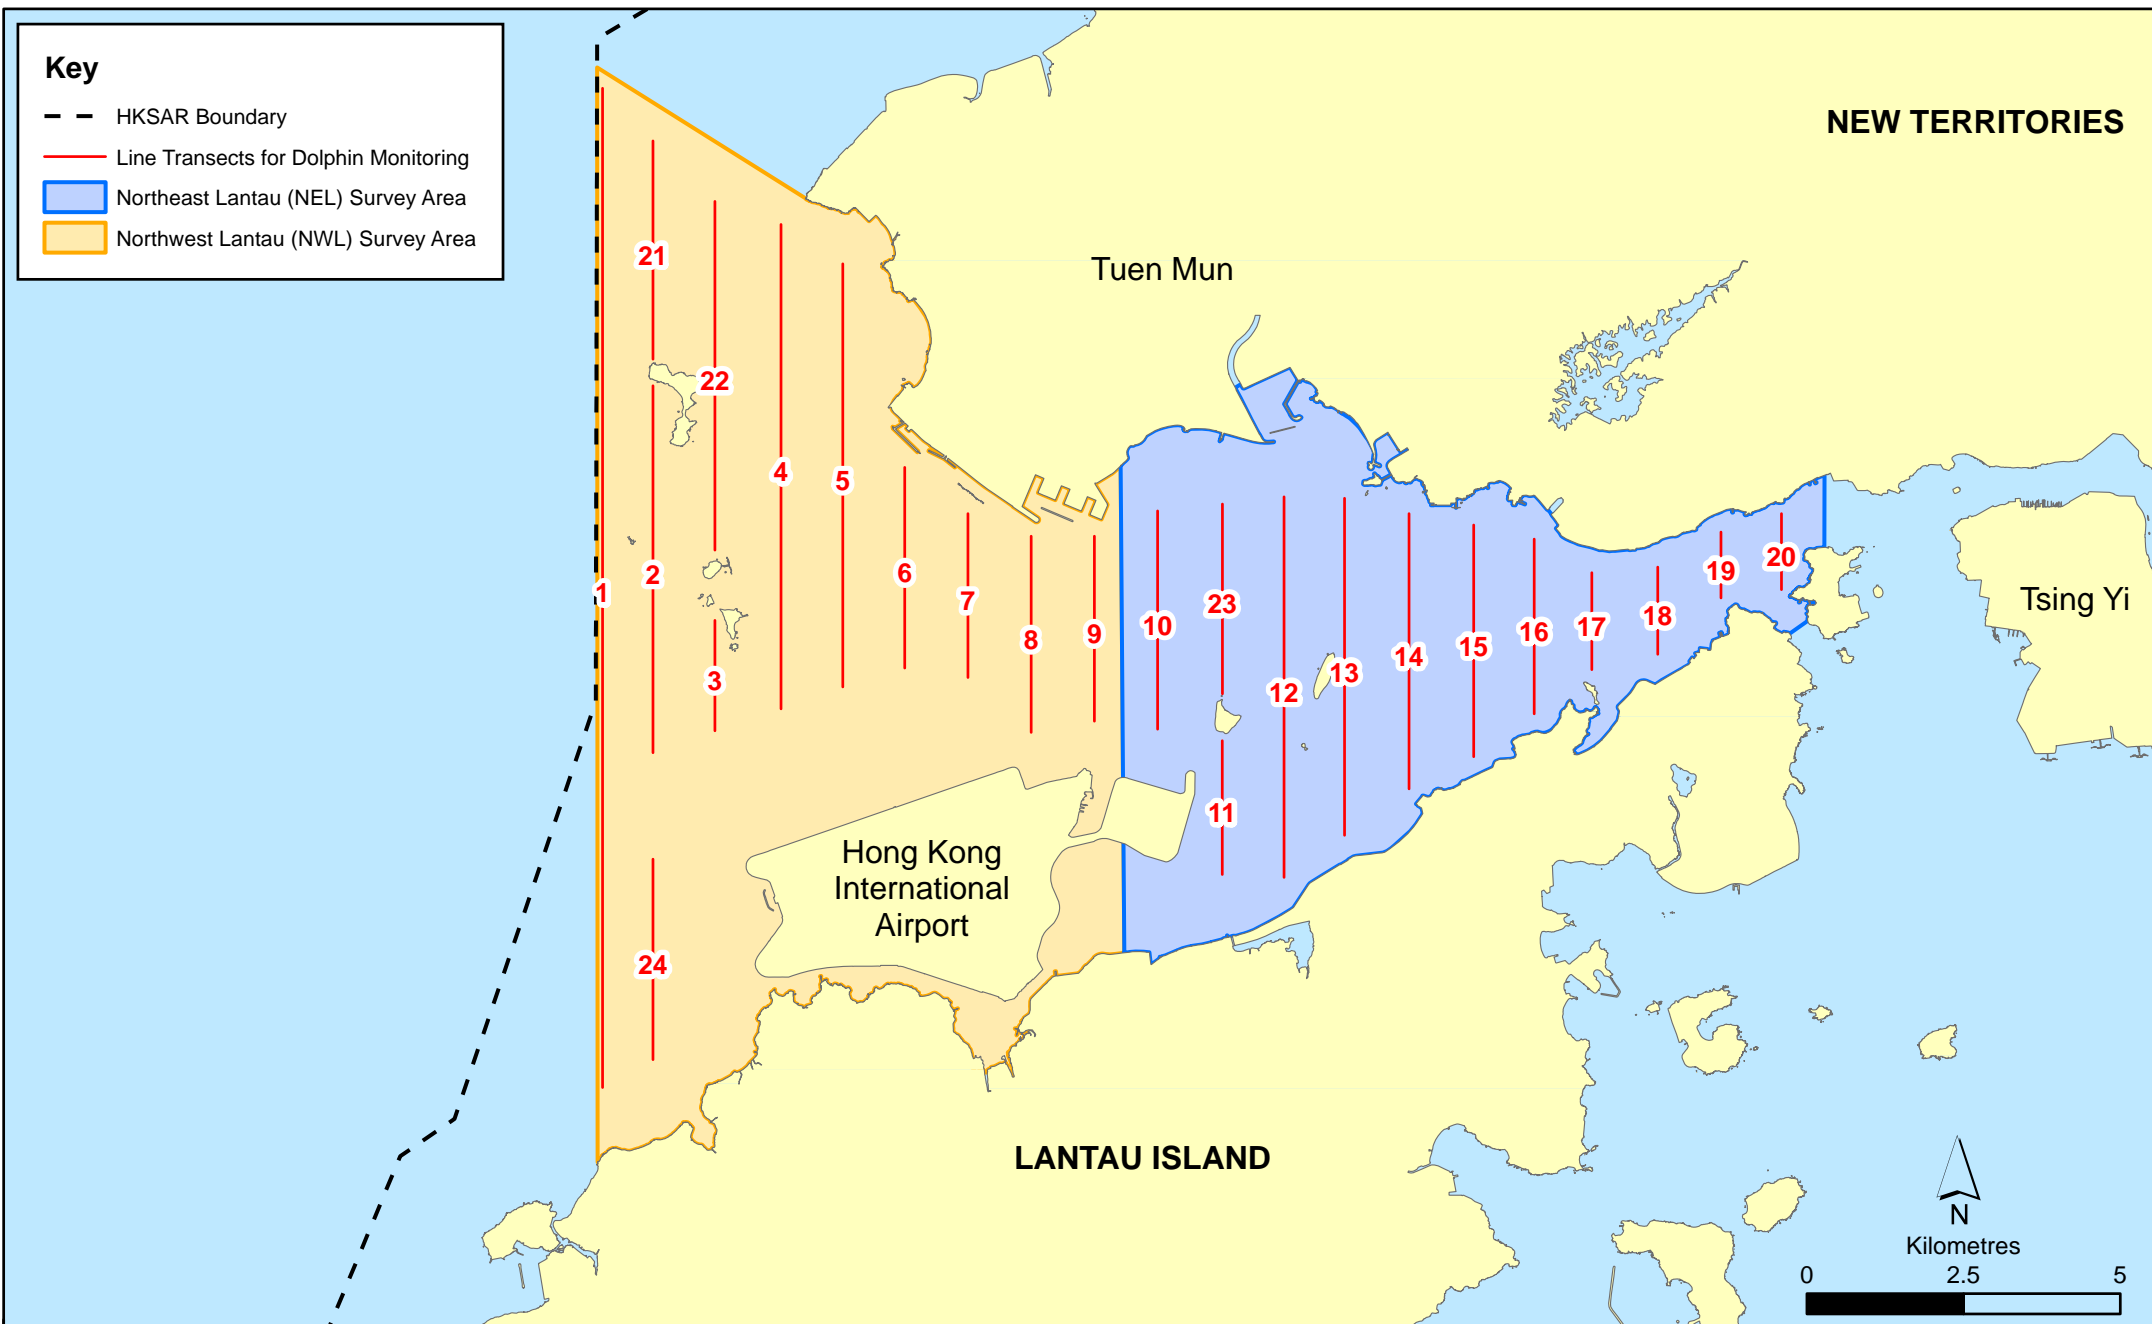


Figure 2.4

Layout of Transect Lines of Dolphin Monitoring in Northwest and Northeast Lantau Areas

**Table 2.11 Impact Dolphin Monitoring Line Transect Co-ordinates**

Line No.		Easting	Northing	Line No.		Easting	Northing
1	Start Point	804671	815456	13	Start Point	816506	819480
1	End Point	804671	831404	13	End Point	816506	824859
2	Start Point	805476	820800	14	Start Point	817537	820220
2	End Point	805476	826654	14	End Point	817537	824613
3	Start Point	806464	821150	15	Start Point	818568	820735
3	End Point	806464	822911	15	End Point	818568	824433
4	Start Point	807518	821500	16	Start Point	819532	821420
4	End Point	807518	829230	16	End Point	819532	824209
5	Start Point	808504	821850	17	Start Point	820451	822125
5	End Point	808504	828602	17	End Point	820451	823671
6	Start Point	809490	822150	18	Start Point	821504	822371
6	End Point	809490	825352	18	End Point	821504	823761
7	Start Point	810499	822000*	19	Start Point	822513	823268
7	End Point	810499	824613	19	End Point	822513	824321
8	Start Point	811508	821123	20	Start Point	823477	823402
8	End Point	811508	824254	20	End Point	823477	824613
9	Start Point	812516	821303	21	Start Point	805476	827081
9	End Point	812516	824254	21	End Point	805476	830562
10	Start Point	813525	821176	22	Start Point	806464	824033
10	End Point	813525	824657	22	End Point	806464	829598
11	Start Point	814556	818853	23	Start Point	814559	821739
11	End Point	814556	820992	23	End Point	814559	824768
12	Start Point	815542	818807	24	Start Point	805476	815900
12	End Point	815542	824882	24	End Point	805476	819100

**2.4.5 Action & Limit Levels**

The Action and Limit levels of dolphin impact monitoring are shown in *Appendix D*. The Event and Action plan is presented in *Appendix L*.

## 2.4.6 *Monitoring Schedule for the Reporting Month*

Dolphin monitoring was carried out on 3, 9, 12 and 20 July 2018 (*Appendix F*).

## 2.4.7 *Results and Observations*

A total of 259.03 km of survey effort was collected, with 94.7% of the total survey effort being conducted under favourable weather conditions (i.e. Beaufort Sea State 3 or below with good visibility) during the surveys in July 2018. Among the two areas, 97.80 km and 161.23 km of survey effort were collected from NEL and NWL survey areas, respectively. The total survey effort conducted on primary and secondary lines were 188.97 km and 70.06 km, respectively. The survey efforts are summarized in *Appendix K*.

One (1) group of 4 Chinese White Dolphins were sighted during the two sets of monitoring surveys in July 2018. All dolphin sightings were made in NWL, while none was sighted in NEL. During the surveys in July 2018, the sighting was made during on-effort search while the sighting was made on primary lines. None of the dolphin groups was associated with operating fishing vessel and was not sighted in the proximity of the Project's alignment. The distribution of dolphin sighting during the reporting month is shown in *Figure 2.5*.

Encounter rates of Chinese White Dolphins are deduced from the survey effort and on-effort sighting data made under favourable conditions (Beaufort 3 or below) in July 2018 are shown in *Tables 2.12 & 2.13*.

**Table 2.12 *Individual Survey Event Encounter Rates***

		Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)	Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)
		Primary Lines Only	Primary Lines Only
NEL	Set 1: July 3 <sup>rd</sup> / 9 <sup>th</sup>	0.0	0.0
	Set 2: July 12 <sup>th</sup> / 20 <sup>th</sup>	0.0	0.0
NWL	Set 1: July 3 <sup>rd</sup> / 9 <sup>th</sup>	0.0	0.0
	Set 2: July 12 <sup>th</sup> / 20 <sup>th</sup>	1.7	6.7

Note: Dolphin Encounter Rates are deduced from the two sets of surveys (two surveys in each set) in July 2018 in Northeast (NEL) and Northwest Lantau (NWL)



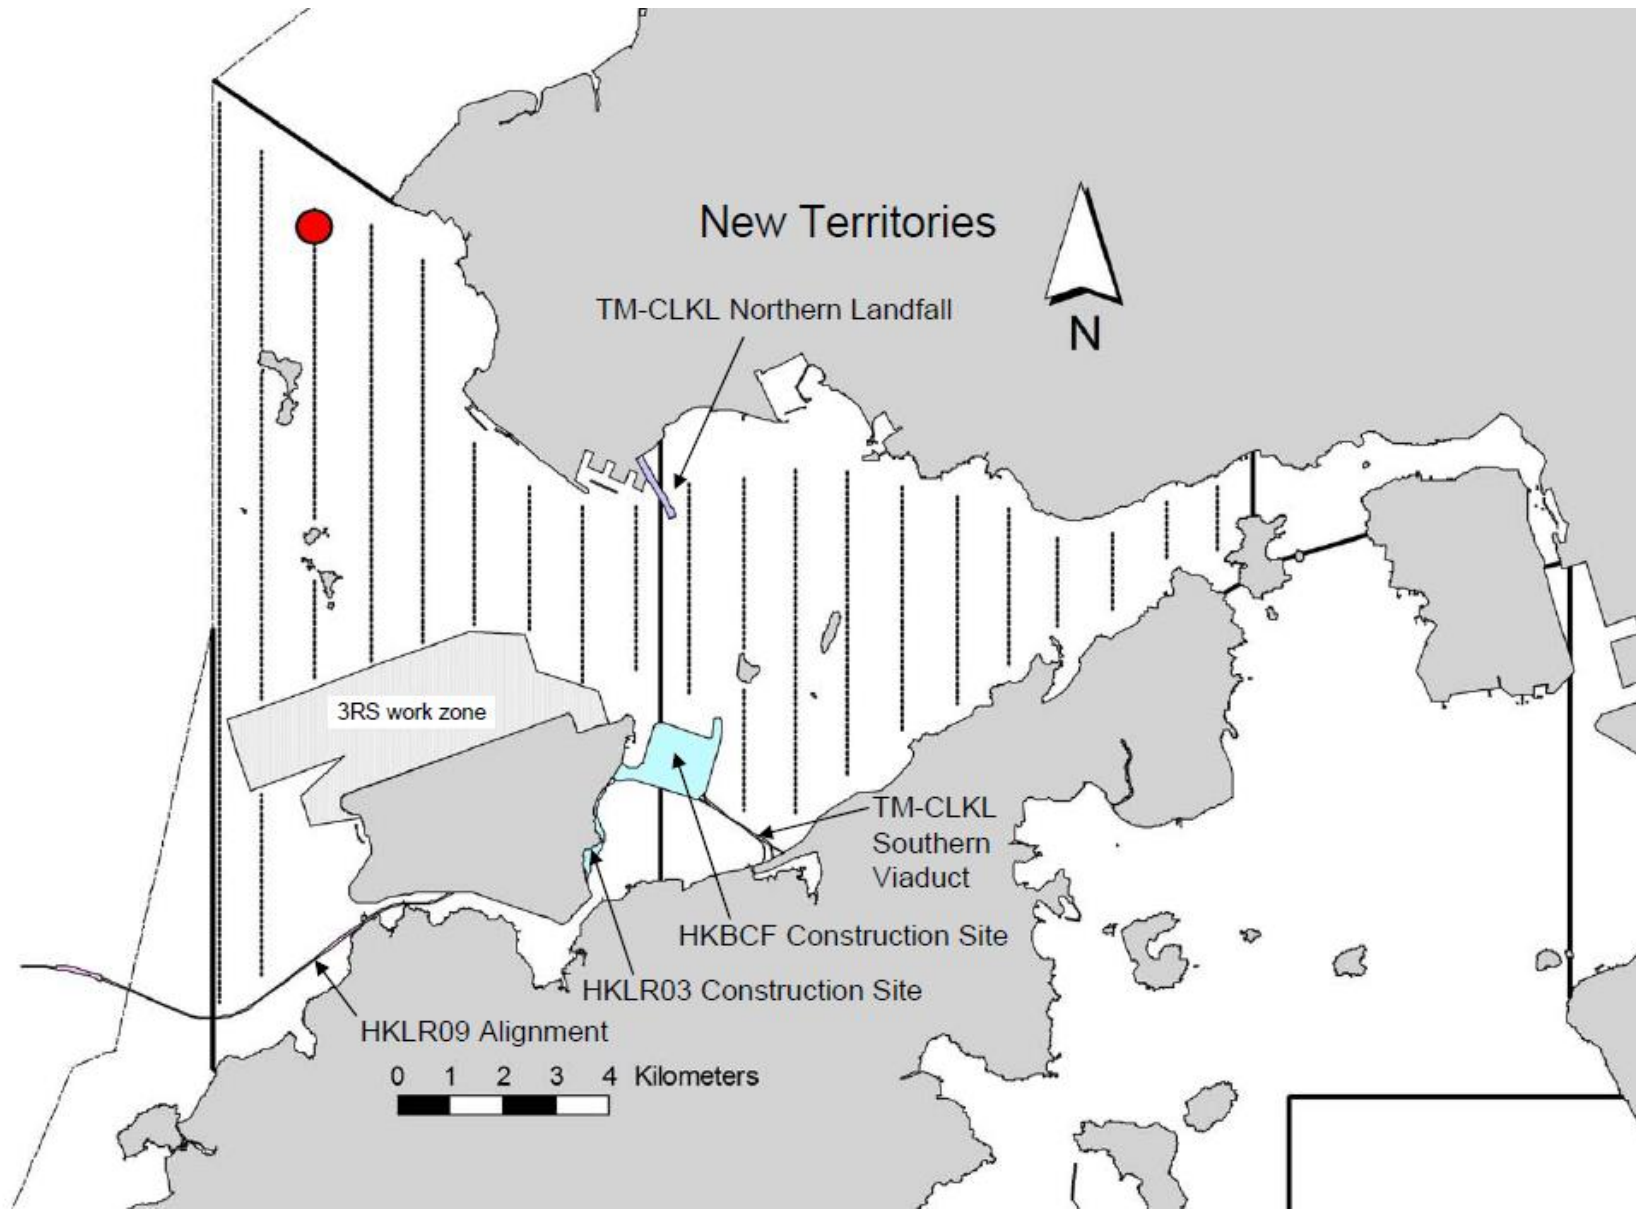


Figure 2.5

Date 31/07/2018

HY/2012/07 TM-CLKL Southern Connection Viaduct Section  
 The distribution of dolphin sightings during the reporting period  
 (Source: Adopted from HKLR03 Monitoring Survey in July 2018)

Environmental  
 Resources  
 Management



**Table 2.13 Monthly Average Encounter Rates**

	Encounter rate (STG) (no. of on-effort dolphin sightings per 100 km of survey effort)		Encounter rate (ANI) (no. of dolphins from all on-effort sightings per 100 km of survey effort)	
	Primary Lines Only	Both Primary and Secondary Lines	Primary Lines Only	Both Primary and Secondary Lines
<b>Northeast Lantau</b>	0.0	0.0	0.0	0.0
<b>Northwest Lantau</b>	0.9	0.7	3.7	2.7

Note: Overall dolphin encounter rates (sightings per 100 km of survey effort) from all four surveys are conducted in July 2018 on primary lines only as well as both primary lines and secondary lines in Northeast and Northwest Lantau

During this month of dolphin monitoring, no unacceptable impact from the construction activities of the TM-CLKL Southern Connection Viaduct Section on Indo-Pacific humpback dolphin *Sousa chinensis* (i.e. Chinese White Dolphin) was noticeable from general observations. Due to monthly variation in dolphin occurrence within the Study Area, it would be more appropriate to draw conclusion on whether any impacts on dolphins have been detected related to the construction activities of the TM-CLKL Southern Connection Viaduct Section in the quarterly EM&A reports, in which comparison on distribution, group size and encounter rates of dolphins between the quarterly impact monitoring period and baseline monitoring period will be made.

#### 2.4.8 Marine Mammal Exclusion Zone Monitoring

Daily 250 m marine mammal exclusion zone monitoring was undertaken during the period of daytime marine works activities. No sighting of Chinese White Dolphin was recorded in July 2018 during the exclusion zone monitoring.

Passive Acoustic Monitoring (PAM) had been decommissioned as no marine piling works was carried out outside the daylight hours since September 2015.

### 2.5 EM&A SITE INSPECTION

Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting month, four (4) site inspections were carried out on 4, 12, 18 and 26 July 2018.

Key observations during the site inspections are summarized in *Table 2.14*.

**Table 2.14 Specific Observations Identified during the Weekly Site Inspections in this Reporting Month**

<b>Inspection Date</b>	<b>Environmental Observations</b>	<b>Recommendations/ Remarks</b>
4 July 2018	Viaduct E (Pier E12) <ul style="list-style-type: none"> <li>Accumulated general refuse on the deck and in the gully should be cleared regularly.</li> </ul> Viaduct E (Pier E13) <ul style="list-style-type: none"> <li>Chemical container was observed not placed in drip tray.</li> </ul>	Viaduct E (Pier E12) <ul style="list-style-type: none"> <li>The Contractor was reminded to clear accumulated general refuse.</li> </ul> Viaduct E (Pier E13) <ul style="list-style-type: none"> <li>The Contractor was reminded to place chemical container in drip tray.</li> </ul>
12 July 2018	Viaduct F (Ramp F) <ul style="list-style-type: none"> <li>The drip tray was observed not properly plugged.</li> </ul> Viaduct E (Pier E14A) <ul style="list-style-type: none"> <li>Accumulated general refuse should be cleared.</li> </ul> Viaduct F (Pier F9) <ul style="list-style-type: none"> <li>The drip tray was observed not properly plugged.</li> </ul>	Viaduct F (Ramp F) <ul style="list-style-type: none"> <li>The Contractor was reminded to plug the drip tray.</li> </ul> Viaduct E (Pier E14A) <ul style="list-style-type: none"> <li>The Contractor was reminded to clear accumulated general refuse.</li> </ul> Viaduct F (Pier F9) <ul style="list-style-type: none"> <li>The Contractor was reminded to plug the drip tray.</li> </ul>
18 July 2018	Viaduct E (Pier E10) <ul style="list-style-type: none"> <li>Stagnant water was observed in the drip tray.</li> </ul> Viaduct E (Pier E6) <ul style="list-style-type: none"> <li>Accumulated general refuse should be cleared.</li> </ul> Viaduct E (Pier E2) <ul style="list-style-type: none"> <li>Empty chemical container should be cleared.</li> </ul>	Viaduct E (Pier E10) <ul style="list-style-type: none"> <li>The Contractor was reminded to clear stagnant water in drip tray.</li> </ul> Viaduct E (Pier E6) <ul style="list-style-type: none"> <li>The Contractor was reminded to clear general refuse.</li> </ul> Viaduct E (Pier E2) <ul style="list-style-type: none"> <li>The Contractor was reminded to clear empty chemical container.</li> </ul>
26 July 2018	Viaduct E (Pier E12) <ul style="list-style-type: none"> <li>Stagnant water in the drip tray should be cleared.</li> </ul> Viaduct E (Pier E11) <ul style="list-style-type: none"> <li>Chemical containers were observed not placed in drip tray</li> </ul>	Viaduct C (Pier C16 and Gate 4A) <ul style="list-style-type: none"> <li>The Contractor was reminded to clear stagnant water in the drip tray.</li> </ul> Viaduct E (Pier E12) <ul style="list-style-type: none"> <li>The Contractor was reminded to place chemical container in drip tray.</li> </ul>

The Contractor has rectified all of the observations identified during environmental site inspections in the reporting month.

## 2.6 WASTE MANAGEMENT STATUS

The Contractor has submitted application form for registration as chemical waste producer under the Contract. Sufficient numbers of receptacles were available for general refuse collection and sorting.

Wastes generated during this reporting period include mainly construction wastes (inert and non-inert) and recyclable materials. Reference has been made to the waste flow table prepared by the Contractor (*Appendix M*). The quantities of different types of wastes are summarized in *Table 2.15*.

**Table 2.15 Quantities of Different Waste Generated in the Reporting Period**

Month/ Year	Inert C&D Materials <sup>(a)</sup> (m <sup>3</sup> )	Imported Fill (m <sup>3</sup> )	Inert Constructio n Waste Re- used (m <sup>3</sup> )	Non-inert Constructio n Waste <sup>(b)</sup> (kg)	Recyclable Materials <sup>(c)</sup> (kg)	Chemical Wastes (kg)	Marine Sediment (m <sup>3</sup> )		
							Category L	Category M (M <sub>p</sub> & M <sub>f</sub> )	Category H
July 2018	1,361	181	208	639,210	13,295	0	0	0	0

**Notes:**

- (a) Inert construction wastes include hard rock and large broken concrete, and materials disposed as public fill.
- (b) Non-inert construction wastes include general refuse disposed at landfill.
- (c) Recyclable materials include metals, paper, cardboard, plastics, timber, felled trees and others.

The Contractor was advised to properly maintain on site C&D materials and waste collection, sorting and recording system, dispose of C&D materials and wastes at designated ground and maximize reuse/ recycle of C&D materials and wastes. The Contractor was also reminded to properly maintain the site tidiness and dispose of the wastes accumulated on site regularly and properly.

For chemical waste containers, the Contractor was reminded to treat properly and store temporarily in designated chemical waste storage area on site in accordance with the *Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes*.

## 2.7 ENVIRONMENTAL LICENSES AND PERMITS

The status of environmental licensing and permit is summarized in *Table 2.16* below.

**Table 2.16 Summary of Environmental Licensing and Permit Status**

License/ Permit	License or Permit No.	Date of Issue	Date of Expiry	License/ Permit Holder	Remarks
Environmental Permit	EP-354/2009/D	13 Mar 2015	N/A	HyD	Tuen Mun- Chek Lap Kok Link
Environmental Permit	EP-353/2009/K	11 Apr 2016	N/A	HyD	Hong Kong Boundary Crossing Facilities
Construction Dust Notification	361571	5 Jul 2013	N/A	GCL	
Construction Dust Notification	362093	17 Jul 2013	N/A	GCL	For Area 23
Chemical Waste Registration	5213-961-G2380-13	10 Oct 2013	N/A	GCL	Chemical waste produced in Contract No. HY/2012/07 (Area 1 adjacent to Cheng Tung Road, Siu Ho Wan)
Chemical Waste Registration	5213-961-G2380-14	10 Oct 2013	N/A	GCL	Chemical waste produced in Contract No. HY/2012/07 (Area 2 adjacent to Cheung Tung Road, Pak Mong Village)
Chemical Waste Registration	5213-974-G2588-03	4 Nov 2013	N/A	GCL	Chemical waste produced in Contract No. HY/2012/07 (WA5 adjacent to Cheung Tung Road, Yam O)
Chemical Waste Registration	5213-951-G2380-17	12 Jun 2014	N/A	GCL	Viaducts A, B, C, D & E
Construction Waste Disposal Account	7017735	10 Jul 2013	N/A	GCL	-
Construction Waste Disposal Account	7019470	3 Mar 2014	N/A	GCL	Vessel CHIT Account
Waste Water Discharge License	WT00019017-2014	13 May 2014	31 May 2019	GCL	Discharge for marine portion
Waste Water Discharge License	WT00019018-2014	13 May 2014	31 May 2019	GCL	Discharge for land portion
Construction Noise Permit for night works and works in general holidays	GW-RW0235-18	21 Jun 2018	18 Dec 2018	GCL	General works at WA5
Construction Noise Permit for night works and works in general holidays	GW-RS0244-18	30 Mar 2018	29 Sep 2018	GCL	Broad Permit for Whole Site Areas
Construction Noise Permit for night works and works in general holidays	GW-RS0426-18	11 Jun 2018	31 Jul 2018	GCL	Broad Permit for Segment Launching at Land Portion
Construction Noise Permit for night works and works in general holidays	GW-RS0064-18	1 Feb 2018	29 Jul 2018	GCL	Pre-casted pile cap shell installation at E8-E13

## 2.8 *IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES*

In response to the site audit findings, the Contractors carried out corrective actions.

A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in *Appendix C*. The necessary mitigation measures were implemented properly for this Contract.

The landscape and visual (L&V) mitigation measures were also monitored on weekly basis in the reporting period. The monitoring status is summarized in *Appendix C*.

## 2.9 *SUMMARY OF EXCEEDANCES OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMIT*

Results for 1-hour TSP, 24-hour TSP and noise complied with the Action/Limit levels in the reporting period.

Four (4) Action Level and one (1) Limit Level of Dissolved Oxygen (DO) exceedances and one (1) Limit Level of Suspended Solids exceedance were recorded for water quality impact monitoring in the reporting month. The exceedances were considered not related to this Contract upon further investigation and the investigation report is presented in *Appendix N*.

Cumulative statistics on exceedances is provided in *Appendix N*.

## 2.10 *SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS*

The Environmental Complaint Handling Procedure is provided in *Figure 2.6*.

There was no complaint, notification of summons or successful prosecution recorded in the reporting period.

Investigation report of complaint regarding noise nuisance on 16 June 2018 is presented in *Appendix N*.

Statistics on complaints, notifications of summons, successful prosecutions are summarized in *Appendix N*.

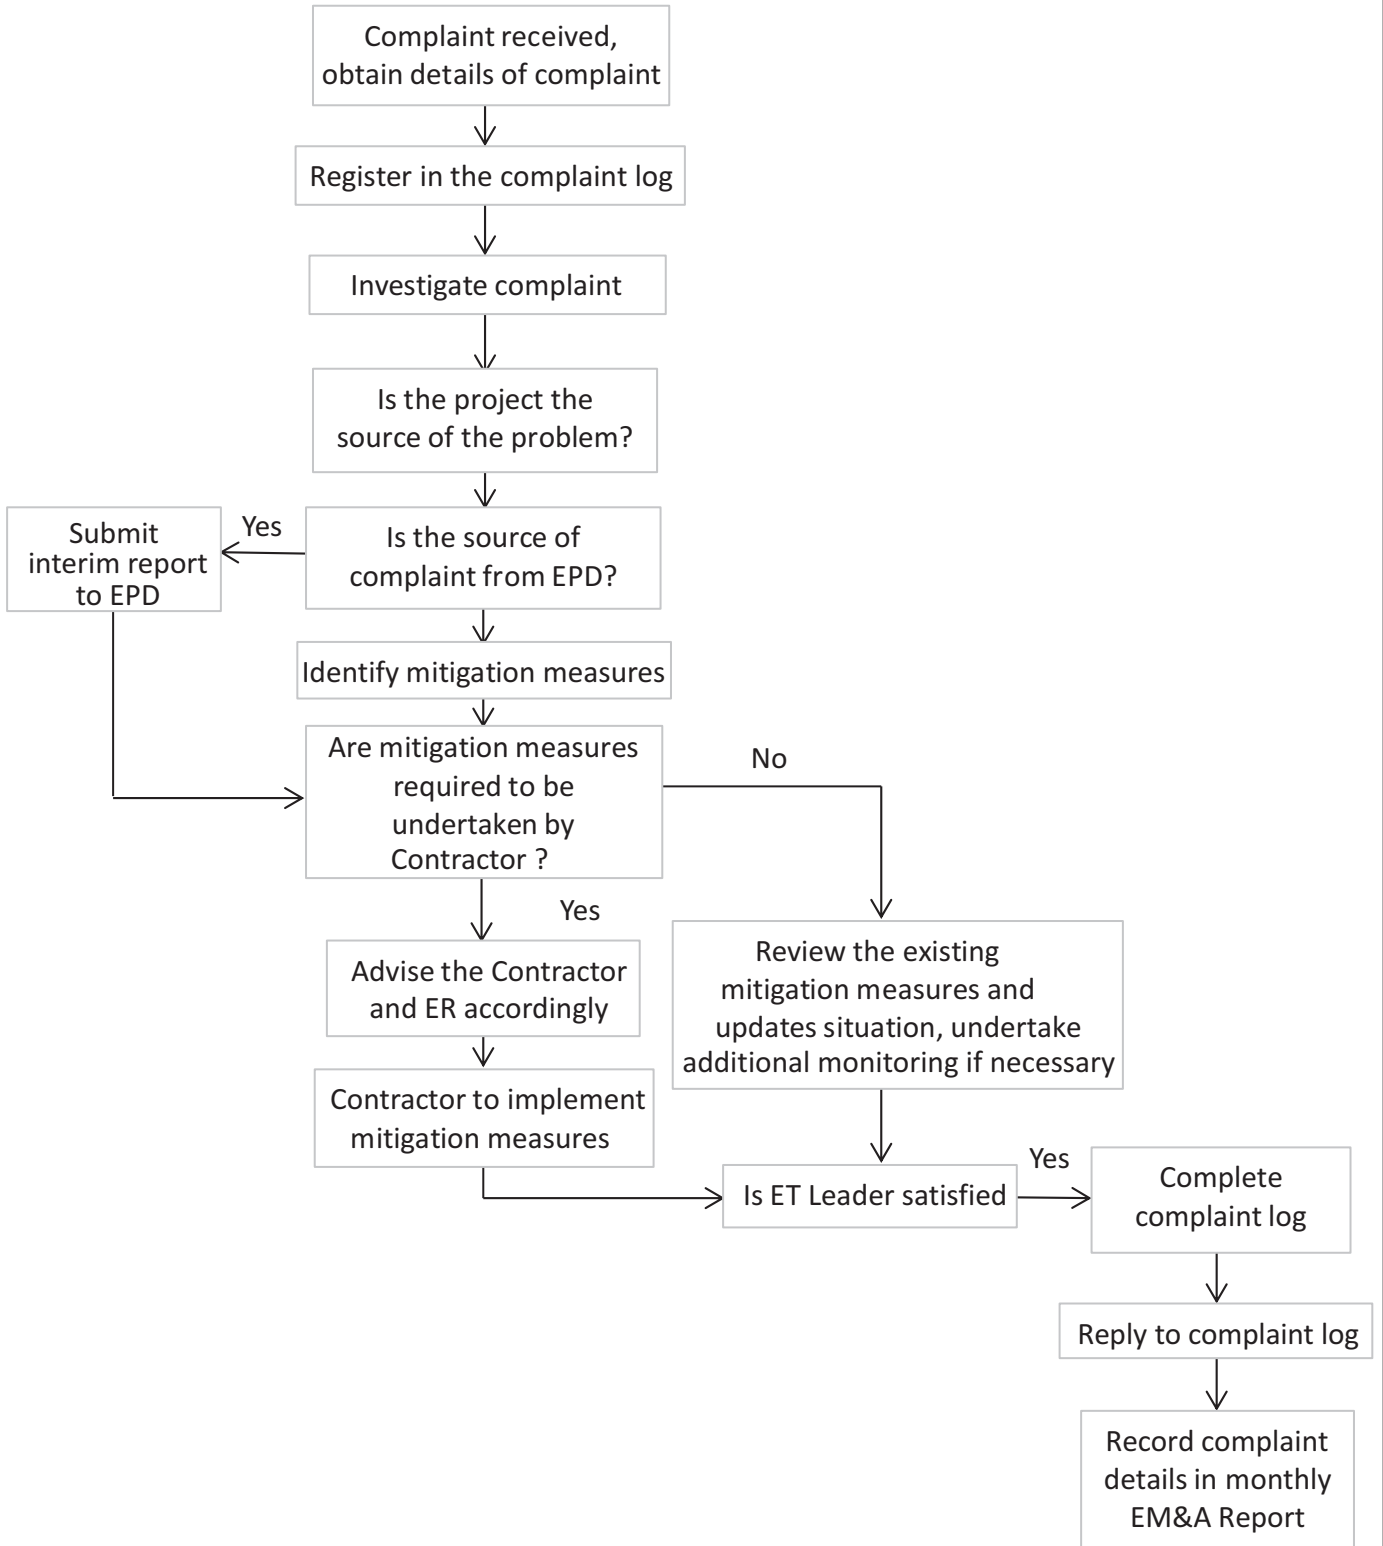


Figure 2.6

Environmental Complaint Handling Procedure

### 3 *FUTURE KEY ISSUES*

#### 3.1 *CONSTRUCTION PROGRAMME FOR THE COMING MONTH*

As informed by the Contractor, the major works for this Contract in August 2018 will be:

##### *Land-based Works*

- Pier construction;
- Demolition of marine platform;
- Re-alignment of Cheung Tung Road;
- Road works along North Lantau Highway;
- Installation of pier head and deck segments;
- Asphalt paving;
- Construction of sign gantries, light poles and street furniture;
- Parapets and barriers installation; and
- Slope work of Viaducts A, B, C & D.

#### 3.2 *KEY ISSUES FOR THE COMING MONTH*

Potential environmental impacts arising from the above upcoming construction activities in the next reporting month of August 2018 are mainly associated with dust, noise, marine water quality, marine ecology and waste management issues.

#### 3.3 *MONITORING SCHEDULE FOR THE COMING MONTH*

The tentative schedules for environmental monitoring in August 2018 are provided in *Appendix F*.



#### 4.1 CONCLUSIONS

This Fifty-seventh Monthly EM&A Report presents the findings of the EM&A activities undertaken during the period from 1 to 31 July 2018 in accordance with the Updated EM&A Manual and the requirements of the Environmental Permits (EP-354/2009/D and EP-353/2009/K).

Air quality (1-hour TSP and 24-hour TSP), noise, water quality (DO, turbidity and SS) and dolphin monitoring were carried out in the reporting month. Results of air quality and noise monitoring complied with the Action and Limit levels in the reporting period.

Four (4) Action Level and one (1) Limit Level of Dissolved Oxygen (DO) exceedances and one (1) Limit Level of Suspended Solids exceedance were recorded for water quality impact monitoring in the reporting month.

One (1) group of 4 Chinese White Dolphins were sighted during the two sets of monitoring surveys in July 2018. During this month of dolphin monitoring, no unacceptable impact from the construction activities of the TM-CLKL Southern Connection Viaduct Section on Indo-Pacific humpback dolphin *Sousa chinensis* (i.e. Chinese White Dolphin) was noticeable from general observations.

Environmental site inspection was carried out four (4) times in July 2018. Recommendations on remedial actions were given to the Contractor for the deficiencies identified during the site audits.


There was no complaint, notification of summons or successful prosecution recorded in the reporting period.

Investigation report of complaint regarding noise nuisance on 16 June 2018 is presented in *Appendix N*.

The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Appendix A

## Project Organization for Environmental Works

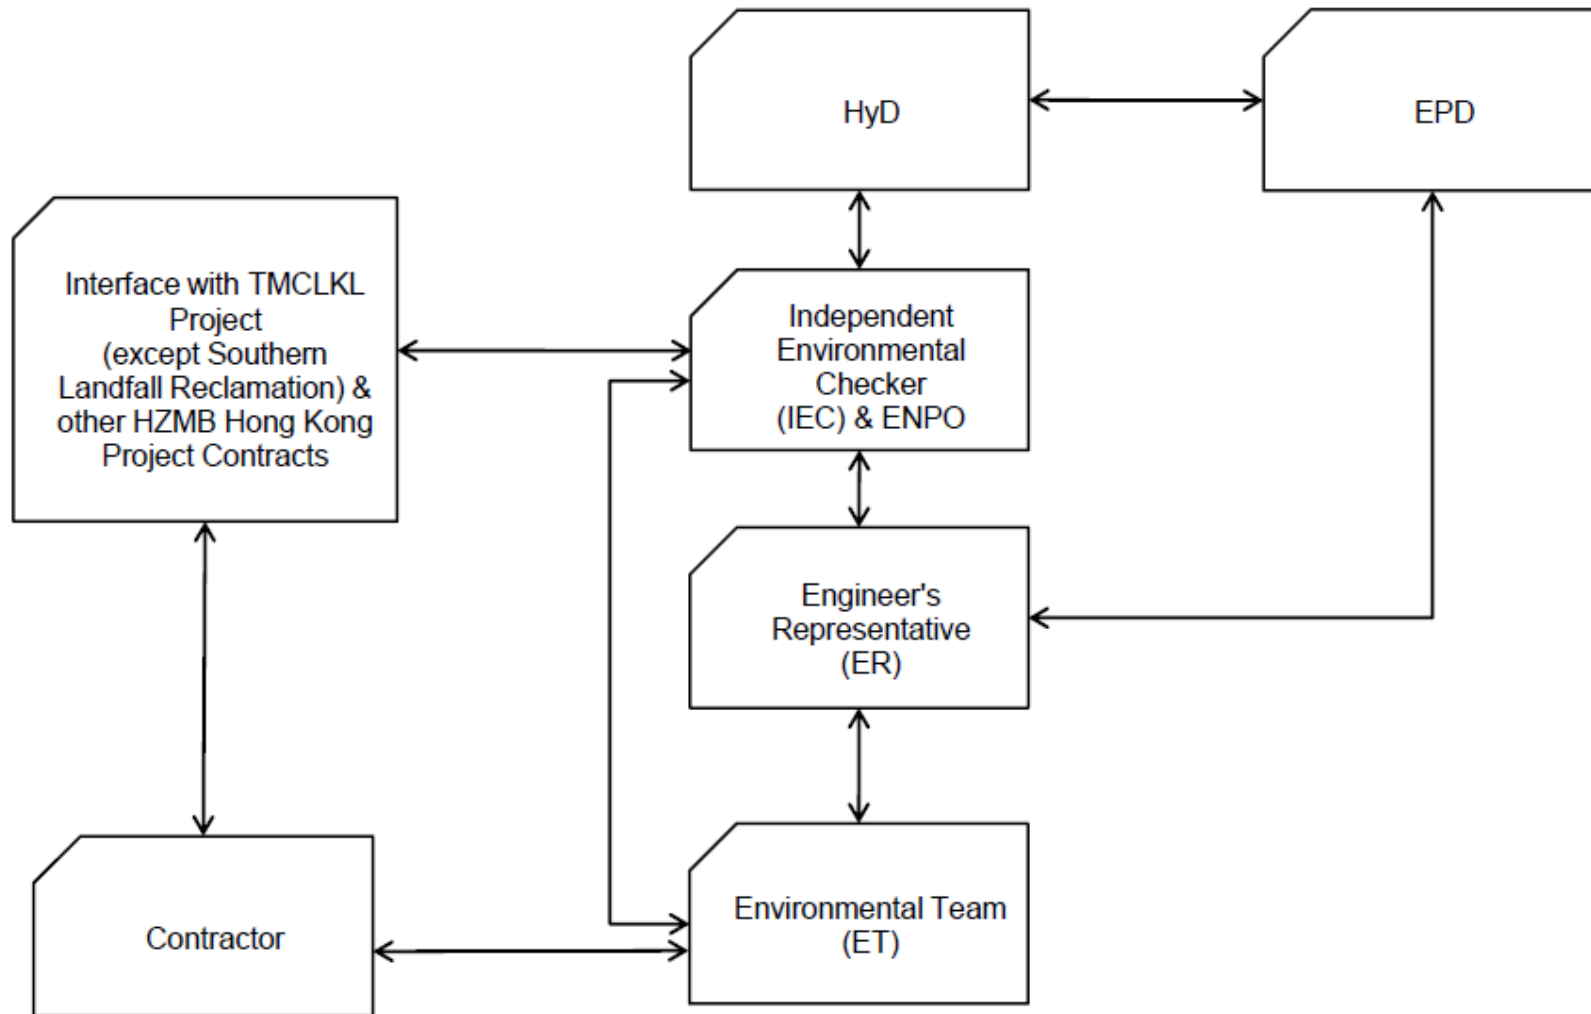

↔ Line of Communication

Appendix B

## Three-Month Rolling Construction Programme



Activity ID	Activity Name	Orig. Durn.	Act. Start / FC Early Start	Rem. Durn.	Act. Finish / FC Early Finish	Late Start	Late Finish	Total Float	Physical % Complete	2018																							
										July					August					September					October								
										25	02	09	16	23	30	06	13	20	27	03	10	17	24	01	08	15	22						
ARF-C6160	Ramp F - Ramp deck	71	09-Jul-18 A	90	06-Nov-18	24-Jan-18	17-May-18	-142	5%																								
<b>Superstructure &amp; Associated Works</b>																																	
<b>Viaduct A</b>																																	
<b>Bridge A2</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VA2-C7840	Viaduct A2 - Outstanding Work	129	23-Jun-18 A	60	29-Sep-18	24-Jan-17	07-Apr-17	-438	10%																								
<b>Bridge A1</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VA1-C7840	Viaduct A1 - Outstanding works	155	23-Jun-18 A	60	29-Sep-18	24-Jan-17	07-Apr-17	-438	10%																								
<b>Viaduct B</b>																																	
<b>Bridge B3</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VB3-C7840	Viaduct B3 - Outstanding works	98	23-Jun-18 A	60	29-Sep-18	24-Jan-17	07-Apr-17	-438	10%																								
<b>Bridge B2</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VB2-C7840	New Activity	98	23-Jun-18 A	60	29-Sep-18	24-Jan-17	07-Apr-17	-438	10%																								
<b>Bridge B1</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VB1-C7840	Viaduct B1 - Outstanding works	98	23-Jun-18 A	60	29-Sep-18	24-Jan-17	07-Apr-17	-438	10%																								
<b>Viaduct C</b>																																	
<b>Bridge C4</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VC4-C7840	Viaduct C4 - Outstanding works	124	12-Feb-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Bridge C3</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VC3-C7840	Viaduct C3 - Outstanding works	124	12-Feb-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Bridge C2</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VC2-C7840	Viaduct C2 - Outstanding works	124	12-Feb-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	90%																								
<b>Bridge C1</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VC1-C7840	Viaduct C1 - outstanding works	124	12-Feb-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Viaduct D</b>																																	
<b>Bridge D3</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VD3-C7840	Viaduct D3 - Outstanding works	66	28-Apr-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Bridge D2</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VD2-C7840	Viaduct D2 - Outstanding works	66	28-Apr-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Bridge D1</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VD1-C7840	Viaduct D1 - Outstanding works	66	28-Apr-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Viaduct E</b>																																	
<b>Bridge E1</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VE1CD-C78	Viaduct E1 - Outstanding works	53	23-Jun-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	90%																								
<b>Bridge E2</b>																																	
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VE23-C7840	Viaduct E2 - Outstanding works	80	21-Jun-18 A	35	30-Aug-18	25-Feb-17	07-Apr-17	-413	95%																								
<b>Bridge E5</b>																																	
<b>Deck Span Segment</b>																																	
E14D-C6610	E14D Deck - Dismantle Truss & Clear Deck (KD1)	15	03-May-18 A	10	01-Aug-18	25-Sep-20	08-Oct-20	649	60%																								
<b>Deck Fnishes, E&amp;M and Roadworks</b>																																	
VE5-C7720	Viaduct E5 - Gantry & TCSS Provisions (KD4)	36	16-Jul-18 A	36	31-Aug-18	04-Apr-18	17-May-18	-88	0%																								
VE5-C7810	Viaduct E5 - Drainage, Fire Main & E&M Services	60	04-Aug-18	60	15-Oct-18	10-May-18	21-Jul-18	-71	0%																								
VE5-C7820	Viaduct E5 - Railings, Light Poles, Signs & Street Furniture	30	01-Sep-18	30	08-Oct-18	15-Jun-18	21-Jul-18	-65	0%																								
VE5-C7830	Viaduct E5 - Deck Paving & Roadmarking (KD9)	18	16-Oct-18	18	06-Nov-18	23-Jul-18	11-Aug-18	-71	0%																								
<b>Bridge E6</b>																																	

■ Actual Work  
■ Planned Bar  
■ Critical Bar  
◆ Milestone

Project ID: TMCLK-DWPL-M62  
 Layout: J3518-DWP-3MRP Submission - M61  
 Filter: TASK filters: 3-Month Lookahead, No CC  
 Milestones, No Level of Effort, remaining activities.

**Tuen Mun - Chek Lap Kok Link - Southern Connection**  
**3-Month Rolling Programme (Page 2 of 5 Pages)**  
**(Progress as of 21-Jun-18)**

Date	Revision	Check...	Approved
24-Apr-18		PKN	HF
28-May-...		PKN	HF
31-Jul-18			HF

**Footer 2DWG. No.:**  
**J3518/GCL/PGM/3MRP-M61**

Activity ID	Activity Name	Orig. Durn.	Act. Start / FC Early Start	Rem. Durn.	Act. Finish / FC Early Finish	Late Start	Late Finish	Total Float	Physical % Complete	2018																
										July					August					September				October		
										25	02	09	16	23	30	06	13	20	27	03	10	17	24	01	08	15
<b>Deck Span Segment</b>																										
VE6-C6910	Viaduct E6 - Final Stressing to Span	12	22-Mar-18 A	45	11-Sep-18	09-Feb-18	10-Apr-18	-128	92%																	
VE6-C6920	Viaduct E6 - Install, grout permanent bearing and load transfer at pier E14C	7	12-Sep-18	7	19-Sep-18	11-Apr-18	18-Apr-18	-128	0%																	
<b>Deck Finishes, E&amp;M and Roadworks</b>																										
VE6-C7710	Viaduct E6 - Parapet Panels	48	21-May-18 A	52	19-Sep-18	09-Feb-18	18-Apr-18	-128	60%																	
VE6-C7720	Viaduct E6 - Gantry & TCSS Provisions (KD4)	36	06-Sep-18	36	20-Oct-18	04-Apr-18	17-May-18	-128	0%																	
VE6-C7810	Viaduct E6 - Drainage, Fire Main & E&M Services	60	20-Sep-18	60	01-Dec-18	17-May-18	28-Jul-18	-105	0%																	
<b>Bridge E7</b>																										
<b>Deck Span Segment</b>																										
VE7-C6910	Viaduct E7 - Final Stressing to Span	12	21-Apr-18 A	52	19-Sep-18	01-Feb-18	10-Apr-18	-135	95%																	
VE7-C6920	Viaduct E7 - Install, grout permanent bearing and load transfer to E14C	7	20-Sep-18	7	28-Sep-18	11-Apr-18	18-Apr-18	-135	0%																	
<b>Deck Finishes, E&amp;M and Roadworks</b>																										
VE7-C7710	Viaduct E7 - Parapet Panels	48	12-May-18 A	58	28-Sep-18	02-Feb-18	18-Apr-18	-135	44%																	
VE7-C7720	Viaduct E7 - Gantry & TCSS Provisions (KD4)	36	14-Sep-18	36	29-Oct-18	04-Apr-18	17-May-18	-135	0%																	
VE7-C7810	Viaduct E7 - Drainage, Fire Main & E&M Services	60	29-Sep-18	60	10-Dec-18	17-May-18	28-Jul-18	-112	0%																	
<b>Bridge E8</b>																										
<b>Deck Finishes, E&amp;M and Roadworks</b>																										
VE8-C7720	Viaduct E8 - Gantry & TCSS Provisions (KD4)	36	17-Jul-18 A	36	31-Aug-18	04-Apr-18	17-May-18	-88	0%																	
VE8-C7810	Viaduct E8 - Drainage, Fire Main & E&M Services	60	04-Aug-18	60	15-Oct-18	10-May-18	21-Jul-18	-71	0%																	
VE8-C7820	Viaduct E8 - Railings, Light Poles, Signs & Street Furniture	30	01-Sep-18	30	08-Oct-18	15-Jun-18	21-Jul-18	-65	0%																	
VE8-C7830	Viaduct E8 - Deck Paving & Roadmarking (KD9)	18	16-Oct-18	18	06-Nov-18	23-Jul-18	11-Aug-18	-71	0%																	
<b>Viaduct F</b>																										
<b>Bridge F1</b>																										
<b>Deck Finishes, E&amp;M and Roadworks</b>																										
VF1-C7720	Viaduct F1 - Gantry & TCSS Provisions (KD4)	36	30-Jun-18 A	18	10-Aug-18	26-Apr-18	17-May-18	-70	50%																	
VF1-C7810	Viaduct F1 - Drainage, Fire Main & E&M Services	60	05-Jul-18 A	18	10-Aug-18	04-Jul-18	24-Jul-18	-15	20%																	
VF1-C7820	Viaduct F1 - Railings, Light Poles, Signs & Street Furniture	30	11-Aug-18	30	14-Sep-18	11-Jun-18	17-Jul-18	-51	0%																	
VF1-C7830	Viaduct F1 - Deck Paving & Roadmarking (KD7)	18	15-Sep-18	18	08-Oct-18	18-Jul-18	07-Aug-18	-51	0%																	
<b>Bridge F2</b>																										
<b>Deck Finishes, E&amp;M and Roadworks</b>																										
VF2-C7710	Viaduct F2 - Parapet Panels	60	21-Jul-18	60	29-Sep-18	12-Jul-18	19-Sep-18	-8	0%																	
VF2-C7720	Viaduct F2 - Gantry & TCSS Provisions (KD6)	48	01-Sep-18	48	30-Oct-18	16-Nov-18	14-Jan-19	62	0%																	
VF2-C7810	Viaduct F2 - Drainage, Fire Main & E&M Services	60	02-Oct-18	60	11-Dec-18	16-Jan-19	29-Mar-19	87	0%																	
<b>Bridge F3</b>																										
<b>Deck Span Segment</b>																										
F10-C6310	F9-F10 Deck - Span Segment (33 nr) - Crane	45	03-Jul-18 A	14	06-Aug-18	17-Mar-18	06-Apr-18	-100	50%																	
F10-C6410	F9-F10 Deck - Stitching to F9 & Clear Deck (KD2)	21	07-Aug-18	21	30-Aug-18	28-Apr-18	24-May-18	-82	0%																	
F11-C6210	F10-F11 Deck - Erect Falsework (stage 1)	14	05-Jul-18 A	14	06-Aug-18	17-Mar-18	06-Apr-18	-100	20%																	
F11-C6310	F10-F11 Deck - Span Segment (15 nr)stage 1 - Crane	14	07-Aug-18	14	22-Aug-18	07-Apr-18	23-Apr-18	-100	0%																	
F11-C6320	F10-F11 - Erect Falsework (stage 2)	14	20-Aug-18	14	04-Sep-18	20-Apr-18	07-May-18	-100	0%																	
F11-C6330	F10-F11 Deck - Span segment (15 nr)stage 2 - Crane	14	05-Sep-18	14	20-Sep-18	08-May-18	24-May-18	-100	0%																	
F11-C6410	F10-F11 Deck - Stitching to F10-F11 and transfer loading to piers	15	21-Sep-18	15	10-Oct-18	25-May-18	11-Jun-18	-100	0%																	
F12-C6210	F11-F12 Deck - Soil Platform, Concrete Blocks, I-Beam (stage 1)	14	12-Jul-18 A	14	22-Aug-18	07-Apr-18	23-Apr-18	-100	40%																	
F12-C6310	F11-F12 Deck - Span Segment (10 nr)stage 1 - Crane	11	23-Aug-18	11	04-Sep-18	24-Apr-18	07-May-18	-100	0%																	
F12-C6320	F11-F12 Deck - Temporary works (stage 2)	14	05-Sep-18	14	20-Sep-18	11-May-18	28-May-18	-97	0%																	
F12-C6330	F11-F12 Deck - Span segment (11 nr)stage 2 - crane	12	21-Sep-18	12	06-Oct-18	29-May-18	11-Jun-18	-97	0%																	
F12-C6410	F11-F12 Deck - Stitching to F11-F12	12	11-Oct-18	12	25-Oct-18	12-Jun-18	26-Jun-18	-100	0%																	
<b>Bridge F4</b>																										
<b>Deck Span Segment</b>																										
E14B-C6410	F16 Deck - Stitching to E14B-F16	12	13-Aug-18	12	25-Aug-18	07-Jun-18	21-Jun-18	-55	0%																	
E14B-C6420	F16 Deck - Grout bearing, release U tendon, stress bar & breakup stitch @ I	14	27-Aug-18	14	11-Sep-18	22-Jun-18	09-Jul-18	-55	0%																	
F16B-C6410	F16 Deck - Stitching to F15-F16	12	30-Jul-18	12	11-Aug-18	24-May-18	06-Jun-18	-55	0%																	
F18-C6420	F18 Deck - Grout bearing & load transfer at F17 & F18	7	27-Jun-18 A	7	28-Jul-18	15-May-18	23-May-18	-55	10%																	
VF4-C6910	Viaduct F4 - Final Stressing	14	12-Sep-18	14	28-Sep-18	10-Jul-18	25-Jul-18	-55	0%																	
<b>Deck Finishes, E&amp;M and Roadworks</b>																										
VF4-C7710	Viaduct F4 - Parapet Panels	48	13-Oct-18	48	08-Dec-18	26-Jul-18	19-Sep-18	-66	0%																	
<b>Bridge F5</b>																										
<b>Deck Span Segment</b>																										
VF5-C6910	Viaduct F5 - Final Stressing and stitching to Span	36	21-Jul-18	36	31-Aug-18	04-Jun-18	17-Jul-18	-39	0%																	
VF5-C6920	Viaduct F5 - Install, grout permanent bearing and load transfer at pier F13	7	01-Sep-18	7	08-Sep-18	18-Jul-18	25-Jul-18	-39	0%																	
<b>Deck Finishes, E&amp;M and Roadworks</b>																										

■ Actual Work  
■ Planned Bar  
■ Critical Bar  
◆ Milestone

Project ID: TMCLK-DWPL-M62  
 Layout: J3518-DWP-3MRP Submission - M61  
 Filter: TASK filters: 3-Month Lookahead, No CC  
 Milestones, No Level of Effort, remaining activities.

**Tuen Mun - Chek Lap Kok Link - Southern Connection**  
**3-Month Rolling Programme (Page 3 of 5 Pages)**  
**(Progress as of 21-Jun-18)**

Date	Revision	Check...	Approved
24-Apr-18		PKN	HF
28-May-...		PKN	HF
31-Jul-18			HF

**Footer 2DWG. No.:**  
**J3518/GCL/PGM/3MRP-M61**

Activity ID	Activity Name	Orig. Durn.	Act. Start / FC Early Start	Rem. Durn.	Act. Finish / FC Early Finish	Late Start	Late Finish	Total Float	Physical % Complete	2018															
										July					August					September				October	
										25	02	09	16	23	30	06	13	20	27	03	10	17	24	01	08
VF5-C7710	Viaduct F5 - Parapet Panels	48	10-Sep-18	48	07-Nov-18	26-Jul-18	19-Sep-18	-39	0%																
<b>CEDD Access Track Re-Provisioning Works</b>																									
<b>Viaduct A to D</b>																									
<b>Access Tracks</b>																									
<b>General</b>																									
PR30060	Construct perm. realignment of CEDD access track at Pier A8	42	21-Jul-18*	42	07-Sep-18	02-Dec-16	23-Jan-17	-480	0%																
PR30070	Construct perm. realignment of CEDD access track at Pier B8	42	14-Aug-18	42	03-Oct-18	28-Dec-16	18-Feb-17	-480	0%																
PR30080	Construct perm. realignment of CEDD access track at Pier C7	42	06-Sep-18	42	27-Oct-18	21-Jan-17	14-Mar-17	-480	0%																
PR30090	Construct perm. realignment of CEDD access track at Pier D8	42	02-Oct-18	42	20-Nov-18	17-Feb-17	07-Apr-17	-480	0%																
<b>At-Grade Works &amp; Miscellaneous Works</b>																									
<b>At-Grade Works Along North Lantau Highway</b>																									
<b>Slope Works Near Viaduct A</b>																									
<b>Slope 9SE-B/FR8</b>																									
GFX501	9SE-B/FR8 - Demolish existing wall stem	31	16-Aug-18	31	20-Sep-18	20-Oct-16	24-Nov-16	-539	0%																
GFX541	9SE-B/FR8 - Construct New Wall Stem	90	21-Sep-18	90	10-Jan-19	25-Nov-16	16-Mar-17	-539	0%																
<b>Slope Works Near Viaduct B</b>																									
<b>Slope 10SW-A/F52</b>																									
GFX495	10SW-A/F52 - Slopework - Phase 1	36	18-Aug-18	36	29-Sep-18	09-Nov-16	20-Dec-16	-524	0%																
GFX535	10SW-A/F52 - Slopework - Phase 2	68	02-Oct-18	68	20-Dec-18	21-Dec-16	16-Mar-17	-524	0%																
<b>Slope Works Near Viaduct D</b>																									
<b>Slope 10NW-C/F9</b>																									
M201205	10NW-C/F9 - Fill and compact filled material	52	03-Apr-18 A	42	07-Sep-18	10-Jan-17	02-Mar-17	-450	60%																
M201210	10NW-C/F9 - Install Geo. Instru. & Baseline Monitoring	30	08-Sep-18	30	15-Oct-18	03-Mar-17	07-Apr-17	-450	0%																
<b>Slope 10NW-C/F10</b>																									
M201230	10NW-C/F10 - Fill and compact filled material	160	16-Oct-17 A	10	01-Aug-18	22-Mar-17	01-Apr-17	-392	95%																
M201300	10NW-C/F10 - Slope drainage	12	26-Jul-18	12	06-Aug-18	26-Mar-17	07-Apr-17	-486	0%																
<b>Slope 10NW-C/F11</b>																									
M201290	10NW-C/F11 - Fill and compact filled material - Phase 2	72	16-Apr-18 A	10	01-Aug-18	27-Mar-17	07-Apr-17	-388	95%																
<b>Slope 10NW-C/F17</b>																									
M201197	10NW-C/F17 - Fill and compact filled material	60	07-May-18 A	48	14-Sep-18	12-Aug-20	08-Oct-20	611	40%																
<b>Road Works Along NLH Westbound</b>																									
<b>General</b>																									
RW11020	NLH W/B (Viaduct B) - Profile Barrier and roadwork	36	23-Apr-18 A	7	28-Jul-18	30-Mar-17	07-Apr-17	-385	90%																
<b>Road Works Along NLH Eastbound</b>																									
<b>General</b>																									
RW20084	NLH E/B Viaduct A - Ch200-388 Roadwork (SL & HS) & Reinstate NLH	127	17-Dec-16 A	60	29-Sep-18	24-Jan-17	07-Apr-17	-438	90%																
<b>At-Grade Works Along Cheung Tung Road</b>																									
<b>Slope Works Near Viaduct B</b>																									
<b>Slope 9SE-B/F85</b>																									
SWVB4035	9SE-B/F85 - Install Geo. Instru. & Baseline Monitoring	30	21-Jul-18	30	24-Aug-18	13-Oct-18	17-Nov-18	70	0%																
SWVB4040	9SE-B/F85 - Hydroseeding	12	25-Aug-18	12	07-Sep-18	19-Nov-18	01-Dec-18	70	0%																
<b>Slope Works Near Viaduct C</b>																									
<b>Slope PF1 &amp; PF2</b>																									
SWVC6990	10NW-PF1 & PF2 complete site site clearance	0	21-Jul-18*	0		21-Dec-17		-212	0%																
SWVC7000	10NW - PF2 slope works	48	21-Jul-18	48	14-Sep-18	21-Dec-17	21-Feb-18	-168	0%																
SWVC7010	10NW - PF2 slope works	52	15-Sep-18*	52	17-Nov-18	22-Feb-18	27-Apr-18	-168	0%																
<b>Slope 10NW-C/F14</b>																									
SWVC6010	10NW-C/F14 - Install Geo. Instru. & Baseline Monitoring	30	21-Jul-18	30	24-Aug-18	20-Mar-18	27-Apr-18	-98	0%																
<b>Slope 10NW-C/F15</b>																									
SWVC6005	10NW-C/F15 - Install Geo. Instru. & Baseline Monitoring	30	21-Jul-18*	30	24-Aug-18	20-Mar-18	27-Apr-18	-98	0%																
<b>Re-alignment of CTR Along Viaduct B</b>																									
<b>General</b>																									
RP00077-1	Ch100-300: Street Lighting, thrie beam, bus stop & water point, etc	48	08-Dec-17 A	35	30-Aug-18	04-May-17	14-Jun-17	-361	85%																
<b>At-Grade Works at Southern Landfall</b>																									
<b>HKBCF Area</b>																									
<b>General</b>																									
RW30014	South Landfall - DN300 Fresh water main works installation & connection (f	60	21-Jul-18	60	29-Sep-18	07-Feb-18	25-Apr-18	-130	0%																
RW30016	South Landfall - Stormwater drainage works (Portion B)	60	15-Sep-18	60	27-Nov-18	12-Apr-18	23-Jun-18	-130	0%																
RW30030	South Landfall - Stormwater drainage works	60	02-Oct-18	60	11-Dec-18	29-Jul-20	08-Oct-20	539	0%																

■ Actual Work  
■ Planned Bar  
■ Critical Bar  
◆ Milestone

Project ID: TMCLK-DWPL-M62  
 Layout: J3518-DWP-3MRP Submission - M61  
 Filter: TASK filters: 3-Month Lookahead, No CC  
 Milestones, No Level of Effort, remaining activities.

**Tuen Mun - Chek Lap Kok Link - Southern Connection**  
**3-Month Rolling Programme (Page 4 of 5 Pages)**  
**(Progress as of 21-Jun-18)**

Date	Revision	Check...	Approved
24-Apr-18		PKN	HF
28-May-...		PKN	HF
31-Jul-18			HF

**Footer 2DWG. No.:**  
**J3518/GCL/PGM/3MRP-M61**



Activity ID	Activity Name	Orig. Durn.	Act. Start / FC Early Start	Rem. Durn.	Act. Finish / FC Early Finish	Late Start	Late Finish	Total Float	Physical % Complete	2018																							
										July					August					September					October								
										25	02	09	16	23	30	06	13	20	27	03	10	17	24	01	08	15	22						
RW30032	South Landfall - Fire mains	60	19-Mar-18 A	60	29-Sep-18	16-Aug-18	27-Oct-18	22	85%	[Gantt bar from 16-Aug-18 to 27-Oct-18]																							
<b>Watermain from Tung Chung to Southern Landfall</b>																																	
<b>Watermain Works</b>																																	
<b>General</b>																																	
TC00070	Sterilisation of Pipes & Testing of Whole DN450 Fresh Watermain	60	18-Aug-18	60	30-Oct-18	13-Nov-18	24-Jan-19	71	0%	[Gantt bar from 18-Aug-18 to 24-Jan-19]																							
WM00190	Viaduct B1 - Lay DN450 Fresh Water Main	42	21-Apr-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	85%	[Gantt bar from 21-Apr-18 to 12-Nov-18]																							
WM00200	Viaduct B2 - Lay DN450 Fresh Water Main	48	30-Apr-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	85%	[Gantt bar from 30-Apr-18 to 12-Nov-18]																							
WM00210	Viaduct B3 - Lay DN450 Fresh Water Main	36	07-May-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	85%	[Gantt bar from 07-May-18 to 12-Nov-18]																							
WM00220	Viaduct E1 - Lay DN450 Fresh Water Main	36	14-May-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	80%	[Gantt bar from 14-May-18 to 12-Nov-18]																							
WM00230	Viaduct E2 - Lay DN450 Fresh Water Main	60	21-May-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	70%	[Gantt bar from 21-May-18 to 12-Nov-18]																							
WM00240	Viaduct E8 - Lay DN450 Fresh Water Main	48	16-Jul-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	20%	[Gantt bar from 16-Jul-18 to 12-Nov-18]																							
WM00250	Viaduct F1 - Lay DN450 Fresh Water Main	36	16-Jul-18 A	24	17-Aug-18	15-Oct-18	12-Nov-18	71	20%	[Gantt bar from 16-Jul-18 to 12-Nov-18]																							
<b>Landscaping Works &amp; Establishment Works</b>																																	
<b>Landscape Softworks</b>																																	
<b>General</b>																																	
LW00012	Deliver & Stockpile Top Soil (29,000 cu.m) to BCF Near Ramp F	180	07-Sep-18	180	16-Apr-19	28-Nov-17	11-Jul-18	-229	0%	[Gantt bar from 07-Sep-18 to 11-Jul-18]																							

- Actual Work
- Planned Bar
- Critical Bar
- ◆ Milestone

Project ID: TMCLK-DWPL-M62  
 Layout: J3518-DWP-3MRP Submission - M61  
 Filter: TASK filters: 3-Month Lookahead, No CC  
 Milestones, No Level of Effort, remaining activities.

**Tuen Mun - Chek Lap Kok Link - Southern Connection**  
**3-Month Rolling Programme (Page 5 of 5 Pages)**  
**(Progress as of 21-Jun-18)**

Date	Revision	Check...	Approved
24-Apr-18		PKN	HF
28-May-...		PKN	HF
31-Jul-18			HF

**Footer 2DWG. No.:**  
**J3518/GCL/PGM/3MRP-M61**

## Appendix C

# Environmental Mitigation and Enhancement Measure Implementation Schedules

(In reference to CINOTECH (2011) Agreement No.  
CE35/2011 EP Baseline Environmental Monitoring for  
Hong Kong-Zhuhai-Macao Bridge Tuen Mun-Chek Lap  
Kok Link - Investigation. Updated EM&A Manual for  
Tuen Mun-Chek Lap Kok Link)

*Contract No. HY/2012/07  
Tuen Mun – Chek Lap Kok Link  
Southern Connection Viaduct Section  
Environmental Mitigation and Enhancement Measure Implementation Schedule*

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
<b>AIR QUALITY</b>									
4.8.1	3.8	An effective watering programme of eight daily watering with complete coverage, is estimated to reduce by 50%. This is recommended for all areas in order to reduce dust levels to a minimum;	All areas / throughout construction period	Contractor	TMEIA Avoid smoke impacts and disturbance		Y		<>
4.8.1	3.8	The Contractor shall, to the satisfaction of the Engineer, install effective dust suppression measures and take such other measures as may be necessary to ensure that at the Site boundary and any nearby sensitive receiver, dust levels are kept to acceptable levels.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓
4.8.1	3.8	The Contractor shall not burn debris or other materials on the works areas.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓
4.8.1	3.8	In hot, dry or windy weather, the watering programme shall maintain all exposed road surfaces and dust sources wet.	All unpaved haul roads / throughout construction period in hot, dry or windy weather	Contractor	TMEIA Avoid smoke impacts and disturbance		Y		<>
4.8.1	3.8	Where breaking of oversize rock/concrete is required, watering shall be implemented to control dust. Water spray shall be used during the handling of fill material at the site and at active cuts, excavation and fill sites where dust is likely to be created.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓
4.8.1	3.8	Open dropping heights for excavated materials shall be controlled to a maximum height of 2m to minimise the fugitive dust arising from unloading.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓
4.8.1	3.8	During transportation by truck, materials shall not be loaded to a level higher than the side and tail boards, and shall be dampened or covered before transport.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
4.8.1	3.8	Materials having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin. The tarpaulin shall be properly secured and shall extend at least 300mm over the edges of the side and tail boards.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓
4.8.1	3.8	No earth, mud, debris, dust and the like shall be deposited on public roads. Wheel washing facility shall be usable prior to any earthworks excavation activity on the site.	All site exits / throughout construction period	Contractor	TMEIA Avoid dust		Y		✓
4.8.1	3.8	Areas of exposed soil shall be minimised to areas in which works have been completed shall be restored as soon as is practicable.	All exposed surfaces / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		✓
4.8.1	3.8	All stockpiles of aggregate or spoil shall be enclosed or covered and water applied in dry or windy condition.	All areas / throughout construction period	Contractor	TMEIA Avoid dust generation		Y		<>
4.11	Section 3	EM&A in the form of 1 hour and 24 hour dust monitoring and site audit	All representative existing ASRs / throughout construction period	Contractor	EM&A Manual		Y		✓
<b>NOISE</b>									
5.11	Section 4	Noise monitoring	All existing representative sensitive receivers / during North Lantau Viaduct construction	Contractor	EM&A Manual		Y		✓
<b>WATER QUALITY</b>									
<i>General Marine Works</i>									
6.10	-	Bored piling to be undertaken within a metal casing.	Marine viaducts of TM-CLKL and HKLR/ bored piling	Contractor	TM-EIAO		Y		✓
6.10	-	Barges and hopper dredgers shall have tight fitting seals to their bottom openings to prevent leakage of material.	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
6.10	-	Any pipe leakages shall be repaired quickly. Plant should not be operated with leaking pipes.	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓
6.10	-	Loading of barges and hoppers shall be controlled to prevent splashing of dredged material to the surrounding water. Barges or hoppers shall not be filled to a level which will cause overflow of materials or pollution of water during loading or transportation.	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓
6.10	-	Excess material shall be cleaned from the decks and exposed fittings of barges and hopper dredgers before the vessel is moved	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓
6.10	-	Adequate freeboard shall be maintained on barges to reduce the likelihood of decks being washed by wave action;	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓
6.10	-	All vessels shall be sized such that adequate clearance is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash.	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓
6.10	-	The works shall not cause foam, oil, grease, litter or other objectionable matter to be present in the water within and adjacent to the works site.	All areas/ throughout construction period	Contractor	Marine Fill Committee Guidelines. DASO permit conditions.		Y		✓
<i>Temporary Staging work</i>									
	5.2	Regular inspection for the accumulation of floating refuse and collection of floating refuse if required	During temporary staging works	Contractor			Y		✓
	5.2	Provision of temporary drainage system on the temporary staging for collection of construction site runoff to allow appropriate treatment before discharge into the sea	During temporary staging works	Contractor			Y		↔
	5.2	Wastewater generated from construction works such as bored / drilling water will be collected, treated, neutralized and de-silted through silt trap or sedimentation tank before disposal	During temporary staging works	Contractor			Y		✓
	5.2	One additional water quality monitoring station is	During temporary	Contractor			Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		proposed at station SR4a In case elevated SS or turbidity is identified during the water quality monitoring, the source of pollution will be tracked down and be removed as soon as possible. In case depletion of dissolved oxygen is identified, artificial aeration will be arranged at the monitoring station SR4a,	staging works						
<i>Land Works</i>									
6.10	-	Wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Sewage effluent and discharges from on- site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the WPCO or collected for disposal offsite. The use of soakaways shall be avoided.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including specifically at the onset of and after each rainstorm.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Temporary access roads should be surfaced with crushed stone or gravel.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Measures should be taken to prevent the washout of construction materials, soil, silt or debris into any drainage system.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
6.10	-	Open stockpiles of construction materials (e.g. aggregates and sand) on site should be covered with tarpaulin or similar fabric during rainstorms.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		↔
6.10	5.8	Manholes (including any newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Discharges of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	All vehicles and plant should be cleaned before they leave the construction site to ensure that no earth, mud or debris is deposited by them on roads. A wheel washing bay should be provided at every site exit.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Wheel wash overflow shall be directed to silt removal facilities before being discharged to the storm drain.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Section of construction road between the wheel washing bay and the public road should be surfaced with crushed stone or coarse gravel.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the WPCO or collected for offsite disposal.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	The Contractor shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance.	All areas/ throughout construction period	Contractor	TM-EIAO Waste Disposal Ordinance		Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
6.10	-	All fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Surface run-off from bunded areas should pass through oil/ grease traps prior to discharge to the stormwater system.	All areas/ throughout construction period	Contractor	TM-EIAO		Y		✓
6.10	-	Roadside gullies to trap silt and grit shall be provided prior to discharging the stormwater into the marine environment. The sumps will be maintained and cleaned at regular intervals.	Roadside/ design and operation	Design Consultant/ Contractor	TM-EIAO	Y		Y	✓
6.10	Section 5	All construction works shall be subject to routine audit to ensure implementation of all EIA recommendations and good working practice.	All areas/ throughout construction period	Contractor	EM&A Manual		Y		✓
<i>Water Quality Monitoring</i>									
6.10	Section 5	Water quality monitoring shall be undertaken for suspended solids, turbidity, and dissolved oxygen. Nutrients and metal parameters shall also be measured for Mf sediment operations (only HKBCF and HKLR required handling of Mf sediment) during baseline, backfilling and post construction period. One year operation phase water quality monitoring at designated stations	Designated monitoring stations as defined in EM&A Manual, Section 5/ Before, through-out marine construction period, post construction and monthly operational phase water quality monitoring for a year.	Contractor	EM&A Manual		Y	Y	✓
<b>ECOLOGY</b>									
8.14	6.3	Specification for and implement pre, during and post construction dolphin abundance monitoring.	All Areas/ Detailed Design/ during construction works/ post construction	Design Consultant/ Contractor	TMEIA	Y	Y	Y	✓
8.14	6.3	Specification for bored piling monitoring	Detailed Design	Design Consultant	TMEIA	Y			n/a
8.14	6.3	Implement any recommendations of the bored piling monitoring	Southern marine viaduct/ Throughout	Contractor	TMEIA		Y		✓



EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
			construction during bored piling						
8.14	6.3,6.5	Avoidance of peak CWD calving season in May and June for driving of metal caissons during bored piling works	Southern marine viaduct/ May and June during bored piling	Contractor	TMEIA		Y		n/a
8.14	6.3,6.5	Specification and implementation of 250m dolphin exclusion zone.	All marine bored piling and temporary staging works areas/Detailed Design/ during all marine bored piling and temporary staging works	Design Consultant/ Contractor	TMEIA	Y	Y		✓
8.15	6.3, 6.5	Specification and deployment of an artificial reef of an area of 3,600 m <sup>2</sup> in an area where fishing activities are prohibited.	Area of prohibited fishing activities/Detailed Design/ towards end of construction period	TM-CLKL/ HKBCF Design Consultant/ TM-CLKL/ HKBCF Contractor	TMEIA	Y		Y	n/a To be enforced by AFCD.
8.14	6.3, 6.5	Specification and implementation of marine vessel control specifications	All areas/Detailed Design/ during construction works	Design Consultant/ Contractor	TMEIA	Y	Y		✓
8.14	6.3, 6.5	Design and implementation of acoustic decoupling methods for marine bored piling and the whole lifespan of temporary staging works.	All areas/ Detailed Design/ during marine bored piling and temporary staging works	Design Consultant/ Contractor	TMEIA	Y	Y		✓
8.15	6.3, 6.4	Pre-construction phase survey and coral translocation	Tai Ho Wan (donor site) and Yam Tsui Wan (receptor site) /Detailed Design/Prior to construction	Design Consultant/ Contractor	TMEIA	Y	Y		n/a
8.15	6.5	Audit coral translocation success	Yam Tsui Wan (receptor site)/Post translocation	Contractor	TMEIA		Y		<b>Completed in October 2014</b>
7.13	6.5	Undertaken gabion wall works in Stream NL1 in the dry season	North Lantau slope works/dry	Contractor	TMEIA		Y		n/a

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
			season/construction phase						
7.13	6.5	The loss of habitat shall be supplemented by enhancement planting in accordance with the landscape mitigation schedule.	All areas / As soon as accessible	Contractor	TMEIA		Y		n/a. To be approved by AFCD/LCSD
7.13	6.5	Spoil heaps shall be covered at all times.	All areas / Throughout construction period	Contractor	TMEIA		Y		✓
7.13	6.5	Avoid damage and disturbance to the remaining and surrounding natural habitat	All areas / Throughout construction period	Contractor	TMEIA		Y		↔
7.13	6.5	Placement of equipment in designated areas within the existing disturbed land	All areas / Throughout construction period	Contractor	TMEIA		Y		↔
7.13	6.5	Disturbed areas to be reinstated immediately after completion of the works.	All areas / Throughout construction period	Contractor	TMEIA		Y		✓
7.13	6.5	Construction activities should be restricted to the proposed works boundary	All areas / Throughout construction period	Contractor	TMEIA		Y		✓
<b>LANDSCAPE AND VISUAL</b>									
10.9	7.6	Round angle, patterned finishes, and oval shaped pier were considered in the viaduct design, and further details will be developed under ACABAS submission (DM3)	All areas/detailed design	Design Consultant	TMEIA	Y			n/a
10.9	7.6	Details of the street furniture will be developed in the detailed design stage (DM4)	All areas/detailed design	Design Consultant	TMEIA	Y			n/a
10.9	7.6	Aesthetic design of the viaduct, retaining wall and other structures will be developed under ACABAS submission (DM5)	All areas/detailed design	Design Consultant	TMEIA	Y			n/a
10.9	7.6	Existing trees on boundary of the Project Area shall be carefully protected during construction. Detailed Tree Protection Specification shall be provided in the Contract Specification. Under this specification, the Contractor shall be required to submit, for approval, a detailed working method statement for the protection of trees	All areas/detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		prior to undertaking any works adjacent to all retained trees, including trees in contractor's works areas. (Tree protection measures will be detailed at Tree Removal Application stage) (CM1)							
10.9	7.6	Trees unavoidably affected by the works shall be transplanted where practical. Trees will be transplanted straight to their final receptor site and not held in a temporary nursery. A detailed Tree Transplanting Specification shall be provided in the Contract Specification. Sufficient time for necessary tree root and crown preparation periods shall be allowed in the project programme (CM2)	All areas/detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓ Tree transplanted as Contract Specification
10.9	7.6	Hillside and roadside screen planting to proposed roads, associated structures and slope works (CM3).	All areas/detailed design/ during construction/post construction	Design Consultant/	TMEIA	Y	Y		✓
10.9	7.6	Hydroseeding or sheeting of soil stockpiles with visually unobtrusive material (in earth tone) (CM4)	All areas/detailed design/ during construction/post construction	Design Consultant/ Contractor	TMEIA	Y	Y		↔
10.9	7.6	Screening of construction works by hoardings around works area in visually unobtrusive colours, to screen works (CM5)	All areas/detailed design/ during construction/post construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓
10.9	7.6	Control night-time lighting and glare by hooding all lights (CM6)	All areas/detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓
10.9	7.6	Ensure no run-off into water body adjacent to the Project Area (CM7)	All areas/detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓
10.9	7.6	Avoidance of excessive height and bulk of buildings and structures (CM8)	All areas/detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
10.9	7.6	Recycle/Reuse all felled trees and vegetation, e.g. mulching (CM9)	All areas/ detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		n/a No felled trees or vegetation suitable for recycle
10.9	7.6	Compensatory tree planting shall be provided to the satisfaction of relevant Government departments. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006 (CM10).	All areas/ detailed design/ during construction	Design Consultant/ Contractor	TMEIA	Y	Y		✓
10.9	7.6	Re-vegetation of affected woodland/shrubland with native species (OM1)	All areas/ detailed design/ during construction/ during operation	Design Consultant/ Contractor	TMEIA	Y	Y	Y	n/a. To be implemented by AFCD/HyD/ L CSD
10.9	7.6	Tall buffer screen tree / shrub / climber planting should be incorporated to soften hard engineering structures and facilities (OM2)	All areas/ detailed design/ during construction/ during operation	Design Consultant/ Contractor	TMEIA	Y	Y	Y	n/a To be implemented by HyD/LCSD
10.9	7.6	Streetscape elements (e.g. paving, signage, street furniture, lighting etc.) shall be sensitively designed in a manner that responds to the local context, and minimises potential negative landscape and visual impacts. Lighting units should be directional and minimise unnecessary light spill (OM3)	All areas/ detailed design/ during construction / during operation	Design Consultant/ Contractor	TMEIA	Y	Y	Y	n/a. To be implemented by HyD/LCSD
10.9	7.6	Structure, ornamental tree / shrub / climber planting should be provided along roadside amenity strips, central dividers and newly formed slopes to enhance the townscape quality and further greenery enhancement	All areas/ detailed design/ during construction / during operation	Design Consultant/ Contractor	TMEIA	Y	Y	Y	n/a. To be implemented by

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		(OM4)							HyD/LCSD
10.9	7.6	Aesthetically pleasing design (visually unobtrusive and non-reflective) as regard to the form, material and finishes	All areas/ detailed design/ during construction / during operation	Design Consultant/ Contractor	TMEIA	Y	Y	Y	n/a. To be implemented by HyD
<b>WASTE</b>									
12.6		The Contractor shall identify a coordinator for the management of waste.	Contract mobilisation	Contractor	TMEIA		Y		✓
12.6		The Contractor shall prepare and implement a Waste Management Plan which specifies procedures such as a ticketing system, to facilitate tracking of loads and to ensure that illegal disposal of wastes does not occur, and protocols for the maintenance of records of the quantities of wastes generated, recycled and disposed. A recording system for the amount of waste generated, recycled and disposed (locations) should be established.	Contract mobilisation	Contractor	TMEIA, Works Branch Technical Circular No. 5/99 for the Trip-ticket System for Disposal of Construction and Demolition Material		Y		✓
12.6		The Contractor shall apply for and obtain the appropriate licenses for the disposal of public fill, chemical waste and effluent discharges.	Contract mobilisation	Contractor	TMEIA, Land (Miscellaneous Provisions) Ordinance (Cap 28); Waste Disposal Ordinance (Cap 354); Dumping at Sea Ordinance (Cap 466); Water Pollution Control Ordinance.		Y		✓
12.6	8.1	Training shall be provided to workers about the concepts of site cleanliness and appropriate waste management procedures including waste reduction, reuse and recycling.	Contract Mobilisation	Contractor	TMEIA		Y		✓
12.6	8.1	The extent of cutting operation should be optimised	All areas / throughout	Contractor	TMEIA		Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		where possible. Earth retaining structures and bored pile walls should be proposed to minimise the extent of cutting.	construction period						
12.6	8.1	Rock armour from the existing seawall should be reused on the new sloping seawall as far as possible	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	The site and surroundings shall be kept tidy and litter free.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	No waste shall be burnt on site.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Provisions to be made in contract documents to allow and promote the use of recycled aggregates where appropriate.	Detailed Design	Design Consultant	TMEIA	Y			n/a
12.6	8.1	The Contractor shall be prohibited from disposing of C&D materials at any sensitive locations. The Contractor should propose the final disposal sites in the EMP and WMP for approval before implementation.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Stockpiled material shall be covered by tarpaulin and /or watered as appropriate to prevent windblown dust/ surface run off.	All areas / throughout construction period	Contractor	TMEIA		Y		↔
12.6	8.1	Excavated material in trucks shall be covered by tarpaulins to reduce the potential for spillage and dust generation.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Wheel washing facilities shall be used by all trucks leaving the site to prevent transfer of mud onto public roads.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Standard formwork or pre-fabrication should be used as far as practicable so as to minimise the C&D materials arising. The use of more durable formwork/plastic facing for construction works should be considered. The use of wooden hoardings should be avoided and metal hoarding should be used to facilitate recycling. Purchasing of construction	All areas / throughout construction period	Contractor	TMEIA		Y		✓

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		materials should avoid over-ordering and wastage.							
12.6	8.1	The Contractor should recycle as many C&D materials (this is a waste section) as possible on-site. The public fill and C&D waste should be segregated and stored in separate containers or skips to facilitate the reuse or recycling of materials and proper disposal. Where practicable, the concrete and masonry should be crushed and used as fill materials. Steel reinforcement bar should be collected for use by scrap steel mills. Different areas of the sites should be considered for segregation and storage activities.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	All falsework will be steel instead of wood.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Chemical waste producers should register with the EPD. Chemical waste should be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes as follows: <ul style="list-style-type: none"> <li>- suitable for the substance to be held, resistant to corrosion, maintained in good conditions and securely closed;</li> <li>- Having a capacity of &lt;450L unless the specifications have been approved by the EPD; and</li> <li>- Displaying a label in English and Chinese according to the instructions prescribed in Schedule 2 of the Regulations. Clearly labelled and used solely for the storage of chemical wastes;</li> <li>- Enclosed with at least 3 sides;</li> <li>- Impermeable floor and bund with capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in the area, whichever is greatest;</li> </ul>	All areas / throughout construction period	Contractor	TMEIA		Y		↔

EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		<ul style="list-style-type: none"> <li>- Adequate ventilation;</li> <li>- Sufficiently covered to prevent rainfall entering (water collected within the bund must be tested and disposed of as chemical waste, if necessary); and</li> <li>- Incompatible materials are adequately separated.</li> </ul>							
12.6	8.1	Waste oils, chemicals or solvents shall not be disposed of to drain,	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Adequate numbers of portable toilets should be provided for on-site workers. Portable toilets should be maintained in reasonable states, which will not deter the workers from utilising them.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Night soil should be regularly collected by licensed collectors.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	General refuse arising on-site should be stored in enclosed bins or compaction units separately from C&D and chemical wastes. Sufficient dustbins shall be provided for storage of waste as required under the Public Cleansing and Prevention of Nuisances By-laws. In addition, general refuse shall be cleared daily and shall be disposed of to the nearest licensed landfill or refuse transfer station. Burning of refuse on construction sites is prohibited.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	All waste containers shall be in a secure area on hard standing;	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Training shall be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including waste reduction, reuse and recycling.	All areas / throughout construction period	Contractor	TMEIA		Y		✓
12.6	8.1	Office wastes can be reduced by recycling of	Site Offices/	Contractor	TMEIA		Y		✓



EIA Reference	EM&A Manual Reference	Environmental Protection Measures	Location/ Timing	Implementation Agent	Relevant Standard or Requirement	Implementation Stages			Status
						D	C	O	
		paper if such volume is sufficiently large to warrant collection. Participation in a local collection scheme by the Contractor should be advocated. Waste separation facilities for paper, aluminium cans, plastic bottles, etc should be provided on-site.	throughout construction period						
12.6	Section 8	EM&A of waste handling, storage, transportation, disposal procedures and documentation through the site audit programme shall be undertaken.	All areas / throughout construction period	Contractor	EM&A Manual		Y		✓
<b>CULTURAL HERITAGE</b>									
11.8	Section 9	EM&A in the form of audit of the mitigation measures	All areas / throughout construction period	Highways Department	EIAO-TM		Y		n/a

**Notes:**

Legend: D=Design, C=Construction, O=Operation

Note: Funding Agent for all mitigation measures will be the Highways Department of the Hong Kong SAR Government

**Status:**

- ✓ Compliance of Mitigation Measures
- <> Compliance of Mitigation but need improvement
- x Non-compliance of Mitigation Measures
- ▲ Non-compliance of Mitigation Measures but rectified by Contractor
- Δ Deficiency of Mitigation Measures but rectified by Contractor
- n/a Not Applicable in Reporting Period

Appendix D

## Summary of Action and Limit Levels

**Table D1** *Action and Limit Levels for 1-hour and 24-hour TSP*

Parameters	Action	Limit
24 Hour TSP Level in $\mu\text{g}/\text{m}^3$	ASR9A/ASR8A = 178 ASR9C/ASR8/ASR9 = 178	260
1 Hour TSP Level in $\mu\text{g}/\text{m}^3$	ASR9A/ASR8A = 394 ASR9C/ASR8/ASR9 = 393	500

**Table D2** *Action and Limit Levels for Construction Noise (0700-1900 hrs of normal weekdays)*

Time Period	Action	Limit
0700-1900 hrs on normal weekdays	When one documented complaint is received	75* dB(A)

**Table D3** *Action and Limit Levels for Water Quality*

Parameter	Action Level#	Limit Level#
DO in mg/L <sup>(a)</sup>	<u>Surface and Middle</u> <b>5.0 mg/L</b>	<u>Surface and Middle</u> <b>4.2 mg/L</b>
	<u>Bottom</u> <b>4.7 mg/L</b>	<u>Bottom</u> <b>3.6 mg/L</b>
Turbidity in NTU (Depth-averaged <sup>(b), (c)</sup> )	120% of upstream control station at the same tide of the same day and 95%-ile of baseline data, i.e., <b>27.5 NTU</b>	130% of upstream control station at the same tide of the same day and 99%-ile of baseline data, i.e., <b>47.0 NTU</b>
SS in mg/L (Depth-averaged <sup>(b), (c)</sup> )	120% of upstream control station at the same tide of the same day and 95%-ile of baseline data, i.e., <b>23.5 mg/L</b>	130% of upstream control station at the same tide of the same day and 10mg/L for WSD Seawater Intakes at Tuen Mun and 99%-ile of baseline data, i.e., <b>34.4 mg/L</b>

**Notes:**

# Baseline data: data from HKZMB Baseline Water Quality Monitoring between 6 and 31 October 2011.

- (a) For DO, non-compliance of the water quality limits occurs when monitoring result is lower than the limits.
- (b) "Depth-averaged" is calculated by taking the arithmetic means of reading of all three depths
- (c) For turbidity and SS, non-compliance of the water quality limits occurs when monitoring result is higher than the limits.
- (d) All figures given in the table are used for reference only, and EPD may amend the figures whenever it is considered as necessary

Parameter	Action Level#	Limit Level#
(e)	The 1%-ile of baseline data for surface and middle DO is 4.2 mg/L, whilst for bottom DO is 3.6 mg/L.	

**Table D4** *Action and Limit Levels for Impact Dolphin Monitoring*

	North Lantau Social Cluster	
	NEL	NWL
Action Level	STG < 70% of baseline & ANI < 70% of baseline	STG < 70% of baseline & ANI < 70% of baseline
Limit Level	[STG < 40% of baseline & ANI < 40% of baseline] and STG < 40% of baseline & ANI < 40% of baseline	

**Notes:**

1. STG means quarterly encounter rate of number of dolphin sightings, which is **6.00 in NEL** and **9.85 in NWL** during the baseline monitoring period
2. ANI means quarterly encounter rate of total number of dolphins, which is **22.19 in NEL** and **44.66 in NWL** during the baseline monitoring period
3. For North Lantau Social Cluster, AL will be trigger if NEL or NWL fall below the criteria; LL will be triggered if both NEL and NWL fall below the criteria.

**Table D5** *Derived Value of Action Level (AL) and Limit Level (LL)*

	North Lantau Social Cluster	
	NEL	NWL
Action Level	STG < 4.2 & ANI < 15.5	STG < 6.9 & ANI < 31.3
Limit Level	[STG < 2.4 & ANI < 8.9] and [STG < 3.9 & ANI < 17.9]	

Appendix E

## Calibration Certificates of Monitoring Equipments

High-Volume TSP Sampler  
5-Point Calibration Record

Location : ASR8(A)  
 Calibrated by : P.F. Yeung  
 Date : 28/05/2018

Sampler

Model : TE-5170  
 Serial Number : S/N 3956

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454  
 Service Date : 19 Mar 2018  
 Slope (m) : 2.05242  
 Intercept (b) : -0.01383  
 Correlation Coefficient(r) : 0.99994

Standard Condition

Pstd (hpa) : 1013  
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1010  
 Ta(K) : 305

Resistance Plate	dH [green liquid] (inch water)	Z	X=Qstd (cubic meter/min)	IC (chart)	Y (corrected)
1   18 holes	11.2	3.303	1.616	56	55.27
2   13 holes	9.0	2.961	1.449	51	50.34
3   10 holes	6.6	2.536	1.242	45	44.41
4   7 holes	4.4	2.070	1.015	38	37.51
5   5 holes	2.6	1.591	0.782	30	29.61

Notes:  $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$ ,  $X = Z/m - b$ ,  $Y(\text{Corrected Flow}) = IC * \{\sqrt{Pa/Pstd}(Tstd/Ta)\}$

Sampler Calibration Relationship (Linear Regression)

Slope(m): 30.570      Intercept(b): 6.100      Correlation Coefficient(r): 0.9945

Checked by: Magnum Fan

Date: 03/06/2018

High-Volume TSP Sampler  
5-Point Calibration Record

Location : ASR8(A)  
 Calibrated by : P.F. Yeung  
 Date : 28/07/2018

Sampler

Model : TE-5170  
 Serial Number : S/N 3956

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454  
 Service Date : 19 Mar 2018  
 Slope (m) : 2.05242  
 Intercept (b) : -0.01383  
 Correlation Coefficient(r) : 0.99994

Standard Condition

Pstd (hpa) : 1013  
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1006  
 Ta(K) : 304

Resistance Plate		dH [green liquid] (inch water)	Z	X=Qstd (cubic meter/min)	IC (chart)	Y (corrected)
1	18 holes	11.0	3.272	1.601	52	51.31
2	13 holes	9.0	2.960	1.449	48	47.36
3	10 holes	6.5	2.515	1.232	43	42.43
4	7 holes	4.2	2.022	0.992	36	35.52
5	5 holes	2.5	1.560	0.767	28	27.63

Notes:  $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$ ,  $X = Z/m - b$ ,  $Y(\text{Corrected Flow}) = IC * \{\sqrt{Pa/Pstd}(Tstd/Ta)\}$

Sampler Calibration Relationship (Linear Regression)

Slope(m): 27.949      Intercept(b): 7.079      Correlation Coefficient(r): 0.9966

Checked by: Magnum Fan

Date: 04/08/2018

High-Volume TSP Sampler  
5-Point Calibration Record

Location : ASR9  
 Calibrated by : P.F. Yeung  
 Date : 28/05/2018

Sampler

Model : TE-5170  
 Serial Number : S/N 3958

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454  
 Service Date : 19 Mar 2018  
 Slope (m) : 2.05242  
 Intercept (b) : -0.01383  
 Correlation Coefficient(r) : 0.99994

Standard Condition

Pstd (hpa) : 1013  
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1010  
 Ta(K) : 305

Resistance Plate		dH [green liquid] (inch water)	Z	X=Qstd (cubic meter/min)	IC (chart)	Y (corrected)
1	18 holes	11.0	3.273	1.602	54	53.30
2	13 holes	9.0	2.961	1.449	48	47.38
3	10 holes	6.7	2.555	1.251	43	42.44
4	7 holes	4.6	2.117	1.038	38	37.51
5	5 holes	2.6	1.591	0.782	28	27.64

Notes:  $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$ ,  $X = Z/m - b$ ,  $Y(\text{Corrected Flow}) = IC * \{\sqrt{Pa/Pstd}(Tstd/Ta)\}$

Sampler Calibration Relationship (Linear Regression)

Slope(m): 29.893      Intercept(b): 5.045      Correlation Coefficient(r): 0.9950

Checked by: Magnum Fan

Date: 03/06/2018



High-Volume TSP Sampler  
5-Point Calibration Record

Location : ASR9  
 Calibrated by : P.F. Yeung  
 Date : 28/07/2018

Sampler

Model : TE-5170  
 Serial Number : S/N 3958

Calibration Orifice and Standard Calibration Relationship

Serial Number : 2454  
 Service Date : 19 Mar 2018  
 Slope (m) : 2.05242  
 Intercept (b) : -0.01383  
 Correlation Coefficient(r) : 0.99994

Standard Condition

Pstd (hpa) : 1013  
 Tstd (K) : 298.18

Calibration Condition

Pa (hpa) : 1006  
 Ta(K) : 304

Resistance Plate		dH [green liquid] (inch water)	Z	X=Qstd (cubic meter/min)	IC (chart)	Y (corrected)
1	18 holes	10.8	3.242	1.587	54	53.28
2	13 holes	8.8	2.927	1.433	48	47.36
3	10 holes	6.6	2.535	1.242	42	41.44
4	7 holes	4.4	2.070	1.015	38	37.49
5	5 holes	2.6	1.591	0.782	30	29.60

Notes:  $Z = \sqrt{dH(Pa/Pstd)(Tstd/Ta)}$ ,  $X = Z/m - b$ ,  $Y(\text{Corrected Flow}) = IC * \{\sqrt{Pa/Pstd}(Tstd/Ta)\}$

Sampler Calibration Relationship (Linear Regression)

Slope(m): 29.069      Intercept(b): 7.825      Correlation Coefficient(r): 0.9935

Checked by: Magnum Fan

Date: 04/08/2018



# Certificate of Calibration

Calibration Certification Information			
Cal. Date: March 19, 2018	Rootsmeter S/N: 438320	Ta: 294	°K
Operator: Jim Tisch		Pa: 746.8	mm Hg
Calibration Model #: TE-5025A	Calibrator S/N: <b>2454</b>		


Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4300	3.2	2.00
2	3	4	1	1.0040	6.4	4.00
3	5	6	1	0.9030	7.9	5.00
4	7	8	1	0.8590	8.7	5.50
5	9	10	1	0.7080	12.8	8.00

Data Tabulation					
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left( \frac{Ta}{Pa} \right)}$ (y-axis)
0.9917	0.6935	1.4113	0.9957	0.6963	0.8874
0.9874	0.9835	1.9959	0.9914	0.9875	1.2549
0.9854	1.0913	2.2315	0.9894	1.0957	1.4030
0.9843	1.1459	2.3405	0.9883	1.1506	1.4715
0.9789	1.3826	2.8227	0.9829	1.3882	1.7747
<b>QSTD</b>	m=	2.05242	<b>QA</b>	m=	1.28519
	b=	-0.01383		b=	-0.00869
	r=	0.99994		r=	0.99994

Calculations			
$Vstd = \Delta Vol \left( \frac{Pa - \Delta P}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)$	$Va = \Delta Vol \left( \frac{Pa - \Delta P}{Pa} \right)$		
$Qstd = Vstd / \Delta Time$	$Qa = Va / \Delta Time$		
<b>For subsequent flow rate calculations:</b>			
$Qstd = 1/m \left( \left( \sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)} \right) - b \right)$	$Qa = 1/m \left( \left( \sqrt{\Delta H \left( \frac{Ta}{Pa} \right)} \right) - b \right)$		

Standard Conditions	
Tstd:	298.15 °K
Pstd:	760 mm Hg
<b>Key</b>	
ΔH: calibrator manometer reading (in H2O)	
ΔP: rootsmeter manometer reading (mm Hg)	
Ta: actual absolute temperature (°K)	
Pa: actual barometric pressure (mm Hg)	
b: intercept	
m: slope	

RECALIBRATION
US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

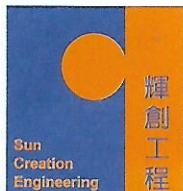

輝創工程有限公司

Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration

## 校正證書

Certificate No. : C181755

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC18-0616)      Date of Receipt / 收件日期 : 20 March 2018

Description / 儀器名稱 : Sound Level Calibrator  
Manufacturer / 製造商 : Rion  
Model No. / 型號 : NC-73  
Serial No. / 編號 : 10486660  
Supplied By / 委託者 : Envirotech Services Co.  
Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,  
New Territories, Hong Kong

### TEST CONDITIONS / 測試條件

Temperature / 溫度 :  $(23 \pm 2)^{\circ}\text{C}$       Relative Humidity / 相對濕度 :  $(50 \pm 25)\%$   
Line Voltage / 電壓 : ---

### TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 5 April 2018


### TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.  
The results do not exceed manufacturer's specification.  
The results are detailed in the subsequent page(s).


The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By  
測試

  
K C Lee  
Engineer

Certified By  
核證

  
H C Chan  
Engineer

Date of Issue  
簽發日期

11 April 2018

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory

c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 - 校正及檢測實驗室

c/o 香港新界屯門興安里一號四樓

Tel/電話: (852) 2927 2606

Fax/傳真: (852) 2744 8986

E-mail/電郵: callab@suncreation.com

Website/網址: www.suncreation.com



輝創工程有限公司

Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No. : C181755

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL130	Universal Counter	C173864
CL281	Multifunction Acoustic Calibrator	PA160023
TST150A	Measuring Amplifier	C181288

4. Test procedure : MA100N.

5. Results :

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value (dB)	Mfr's Spec. (dB)	Uncertainty of Measured Value (dB)
94 dB, 1 kHz	93.7	± 0.5	± 0.2

5.2 Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	Mfr's Spec.	Uncertainty of Measured Value (Hz)
1	0.988	1 kHz ± 2 %	± 1

Remark : The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory

c/o 4/F, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 — 校正及檢測實驗室

c/o 香港新界屯門興安里一號四樓

Tel/電話: (852) 2927 2606

Fax/傳真: (852) 2744 8986

E-mail/電郵: callab@suncreation.com

Website 網址: www.suncreation.com

Page 2 of 2



# Certificate of Calibration

## 校正證書

Certificate No. : C183088  
證書編號

ITEM TESTED / 送檢項目 ( Job No. / 序引編號 : IC18-1089 )      Date of Receipt / 收件日期 : 25 May 2018  
Description / 儀器名稱 : Sound Level Meter  
Manufacturer / 製造商 : Rion  
Model No. / 型號 : NL-52  
Serial No. / 編號 : 00131628  
Supplied By / 委託者 : Envirotech Services Co.  
Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,  
New Territories, Hong Kong

### TEST CONDITIONS / 測試條件

Temperature / 溫度 :  $(23 \pm 2)^{\circ}\text{C}$       Relative Humidity / 相對濕度 :  $(50 \pm 25)\%$   
Line Voltage / 電壓 : ---

### TEST SPECIFICATIONS / 測試規範

Calibration

DATE OF TEST / 測試日期 : 10 June 2018


### TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.  
The results do not exceed manufacturer's specification. (after adjustment)  
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By :   
測試 : K C Lee  
Engineer

Certified By :   
核證 : H C Chan  
Engineer

Date of Issue : 14 June 2018  
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

# Certificate of Calibration

## 校正證書

Certificate No. : C183088

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration using the internal standard (After Adjustment) was performed before the test 6.1.1.2 to 6.3.2.
- The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment :

Equipment ID	Description	Certificate No.
CL280	40 MHz Arbitrary Waveform Generator	C180024
CL281	Multifunction Acoustic Calibrator	PA160023

5. Test procedure : MA101N.

6. Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Adjustment

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	* 95.3	± 1.1

\* Out of IEC 61672 Class 1 Spec.

6.1.1.2 After Adjustment

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	94.0	± 1.1

6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	94.0 (Ref.)
				104.00		104.0
				114.00		114.0

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室所書面批准。

# Certificate of Calibration

## 校正證書

Certificate No. : C183088  
證書編號

### 6.2 Time Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
30 - 130	L <sub>A</sub>	A	Fast	94.00	1	94.0	Ref.
			Slow			94.0	± 0.3

### 6.3 Frequency Weighting

#### 6.3.1 A-Weighting


UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
30 - 130	L <sub>A</sub>	A	Fast	94.00	63 Hz	67.8	-26.2 ± 1.5
					125 Hz	77.8	-16.1 ± 1.5
					250 Hz	85.3	-8.6 ± 1.4
					500 Hz	90.7	-3.2 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	95.2	+1.2 ± 1.6
					4 kHz	95.0	+1.0 ± 1.6
					8 kHz	93.0	-1.1 (+2.1 ; -3.1)
					12.5 kHz	89.6	-4.3 (+3.0 ; -6.0)

#### 6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
30 - 130	L <sub>C</sub>	C	Fast	94.00	63 Hz	93.1	-0.8 ± 1.5
					125 Hz	93.8	-0.2 ± 1.5
					250 Hz	94.0	0.0 ± 1.4
					500 Hz	94.0	0.0 ± 1.4
					1 kHz	94.0	Ref.
					2 kHz	93.8	-0.2 ± 1.6
					4 kHz	93.2	-0.8 ± 1.6
					8 kHz	91.1	-3.0 (+2.1 ; -3.1)
					12.5 kHz	87.6	-6.2 (+3.0 ; -6.0)

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

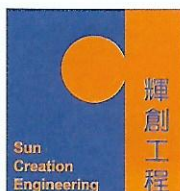

# Certificate of Calibration

## 校正證書

Certificate No. : C183088  
證書編號

- Remarks : - UUT Microphone Model No. : UC-59 & S/N : 10446
- Mfr's Spec. : IEC 61672 Class 1
- Uncertainties of Applied Value :
- |        |                  |                          |
|--------|------------------|--------------------------|
| 94 dB  | : 63 Hz - 125 Hz | : ± 0.35 dB              |
|        | 250 Hz - 500 Hz  | : ± 0.30 dB              |
|        | 1 kHz            | : ± 0.20 dB              |
|        | 2 kHz - 4 kHz    | : ± 0.35 dB              |
|        | 8 kHz            | : ± 0.45 dB              |
|        | 12.5 kHz         | : ± 0.70 dB              |
| 104 dB | : 1 kHz          | : ± 0.10 dB (Ref. 94 dB) |
| 114 dB | : 1 kHz          | : ± 0.10 dB (Ref. 94 dB) |
- The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。





專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH040200  
Date of Issue : 04 May 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin,  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI ProDSS (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 16H104234  
Date of Received : Apr 30, 2018  
Date of Calibration : Apr 30, 2018 to Apr 30, 2018  
Date of Next Calibration<sup>(a)</sup> : Jul 30, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.05	0.05	Satisfactory
7.42	7.46	0.04	Satisfactory
10.01	10.08	0.07	Satisfactory

Tolerance of pH should be less than  $\pm 0.10$  (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
13.0	13.1	0.1	Satisfactory
25.0	25.1	0.1	Satisfactory
38.0	38.3	0.3	Satisfactory


Tolerance limit of temperature should be less than  $\pm 2.0$  (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.  
<sup>(b)</sup> The results relate only to the calibrated equipment as received  
<sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.  
<sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.  
<sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted form relevant international standards.

APPROVED SIGNATORY:

  
LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH040200  
Date of Issue : 04 May 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.11	0.11	Satisfactory
2.56	2.68	0.12	Satisfactory
4.72	4.69	-0.03	Satisfactory
6.76	6.7	-0.06	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	143.2	-2.5	Satisfactory
0.01	1412	1437	1.8	Satisfactory
0.1	12890	12840	-0.4	Satisfactory
0.5	58670	57789	-1.5	Satisfactory
1.0	111900	108344	-3.2	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.87	-1.3	Satisfactory
20	20.23	1.2	Satisfactory
30	30.60	2.0	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.1	--	--
10	10.1	1.0	Satisfactory
20	19.7	-1.5	Satisfactory
100	103.4	3.4	Satisfactory
800	813.2	1.7	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

#### Remark(s): -

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH070142  
Date of Issue : 26 July 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin,  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI ProDSS (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 16H104234  
Date of Received : Jul 25, 2018  
Date of Calibration : Jul 25, 2018 to Jul 25, 2018  
Date of Next Calibration<sup>(a)</sup> : Oct 25, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.02	0.02	Satisfactory
7.42	7.48	0.06	Satisfactory
10.01	10.04	0.03	Satisfactory

Tolerance of pH should be less than ±0.10 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
10.0	10.1	0.1	Satisfactory
25.6	25.5	-0.1	Satisfactory
39.0	38.9	-0.1	Satisfactory


Tolerance limit of temperature should be less than ±2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.  
<sup>(b)</sup> The results relate only to the calibrated equipment as received  
<sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.  
<sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.  
<sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted form relevant international standards.

APPROVED SIGNATORY:

  
LAM Ho-ye, Emma  
Assistant Laboratory Manager



## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH070142  
Date of Issue : 26 July 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.06	0.06	Satisfactory
4.99	4.92	-0.07	Satisfactory
6.40	6.38	-0.02	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	156.6	6.6	Satisfactory
0.01	1412	1381	-2.2	Satisfactory
0.1	12890	12411	-3.7	Satisfactory
0.5	58670	54019	-7.9	Satisfactory
1.0	111900	104782	-6.4	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.61	-3.9	Satisfactory
20	19.82	-0.9	Satisfactory
30	30.48	1.6	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(1)</sup> (NTU)	Tolerance <sup>(2)</sup> (%)	Results
0	0.08	--	--
10	10.4	4.0	Satisfactory
20	20.82	4.1	Satisfactory
100	97.02	-3.0	Satisfactory
800	762.8	-4.7	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

**Remark(s): -**

<sup>(1)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(2)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH040201  
Date of Issue : 04 May 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin,  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI ProDSS (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 17H105557  
Date of Received : Apr 30, 2018  
Date of Calibration : Apr 30, 2018 to Apr 30, 2018  
Date of Next Calibration<sup>(a)</sup> : Jul 30, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

<u>Parameter</u>	<u>Reference Method</u>
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.04	0.04	Satisfactory
7.42	7.45	0.03	Satisfactory
10.01	10.07	0.06	Satisfactory

Tolerance of pH should be less than  $\pm 0.10$  (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
13.0	13.2	0.2	Satisfactory
25.0	25.2	0.2	Satisfactory
38.0	38.1	0.1	Satisfactory


Tolerance limit of temperature should be less than  $\pm 2.0$  (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.  
<sup>(b)</sup> The results relate only to the calibrated equipment as received  
<sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.  
<sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.  
<sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted from relevant international standards.

APPROVED SIGNATORY:

  
LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH040201  
Date of Issue : 04 May 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.14	0.14	Satisfactory
2.56	2.64	0.08	Satisfactory
4.72	4.66	-0.06	Satisfactory
6.76	6.67	-0.09	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	150.1	2.2	Satisfactory
0.01	1412	1439	1.9	Satisfactory
0.1	12890	12876	-0.1	Satisfactory
0.5	58670	57766	-1.5	Satisfactory
1.0	111900	108629	-2.9	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.9	-1.0	Satisfactory
20	20.34	1.7	Satisfactory
30	30.54	1.8	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.1	--	--
10	10.2	2.0	Satisfactory
20	19.6	-2.0	Satisfactory
100	103	3.0	Satisfactory
800	808.3	1.0	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

#### Remark(s): -

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

# REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH070141  
Date of Issue : 26 July 2018  
Page No. : 1 of 2

## PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin,  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

## PART B – DESCRIPTION

Name of Equipment : YSI ProDSS (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 17H105557  
Date of Received : Jul 25, 2018  
Date of Calibration : Jul 25, 2018 to Jul 26, 2018  
Date of Next Calibration<sup>(a)</sup> : Oct 25, 2018

## PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

## PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.04	0.04	Satisfactory
7.42	7.48	0.06	Satisfactory
10.01	10.00	-0.01	Satisfactory

Tolerance of pH should be less than ±0.10 (pH unit)

### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
10.0	10.2	0.2	Satisfactory
25.6	25.7	0.1	Satisfactory
39.0	39.2	0.2	Satisfactory


Tolerance limit of temperature should be less than ±2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.
- <sup>(b)</sup> The results relate only to the calibrated equipment as received
- <sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.
- <sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.
- <sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted from relevant international standards.

APPROVED SIGNATORY:

  
LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH070141  
Date of Issue : 26 July 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.08	0.08	Satisfactory
4.99	5.01	0.02	Satisfactory
6.40	6.43	0.03	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	152.8	4.0	Satisfactory
0.01	1412	1340	-5.1	Satisfactory
0.1	12890	12456	-3.4	Satisfactory
0.5	58670	54401	-7.3	Satisfactory
1.0	111900	104586	-6.5	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.63	-3.7	Satisfactory
20	19.76	-1.2	Satisfactory
30	30.56	1.9	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.07	--	--
10	9.36	-6.4	Satisfactory
20	20.97	4.8	Satisfactory
100	96.48	-3.5	Satisfactory
800	748.6	-6.4	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

Remark(s): -

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.





專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060169  
Date of Issue : 28 June 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI ProDSS (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 16H104233  
Date of Received : Jun 27, 2018  
Date of Calibration : Jun 27, 2018 to Jun 27, 2018  
Date of Next Calibration<sup>(a)</sup> : Sep 27, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	3.96	-0.04	Satisfactory
7.42	7.44	0.02	Satisfactory
10.01	10.11	0.10	Satisfactory

Tolerance of pH should be less than  $\pm 0.10$  (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
12.6	12.5	-0.1	Satisfactory
37.4	37.5	0.1	Satisfactory
62.7	61.5	-1.2	Satisfactory

Tolerance limit of temperature should be less than  $\pm 2.0$  (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.  
<sup>(b)</sup> The results relate only to the calibrated equipment as received  
<sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.  
<sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.  
<sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted from relevant international standards.

APPROVED SIGNATORY:

LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060169  
Date of Issue : 28 June 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.03	0.03	Satisfactory
4.37	4.46	0.09	Satisfactory
5.96	6.10	0.14	Satisfactory
7.34	7.36	0.02	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu$ S/cm)	Displayed Reading ( $\mu$ S/cm)	Tolerance (%)	Results
0.001	146.9	150.0	2.1	Satisfactory
0.01	1412	1398	-1.0	Satisfactory
0.1	12890	12724	-1.3	Satisfactory
0.5	58670	58012	-1.1	Satisfactory
1.0	111900	110847	-0.9	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.97	-0.3	Satisfactory
20	20.14	0.7	Satisfactory
30	30.28	0.9	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.1	--	--
10	10.16	1.6	Satisfactory
20	20.19	1.0	Satisfactory
100	98.84	-1.2	Satisfactory
800	793.16	-0.9	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

**Remark(s): -**

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060170  
Date of Issue : 28 June 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI ProDSS (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 17E100747  
Date of Received : Jun 27, 2018  
Date of Calibration : Jun 27, 2018 to Jun 27, 2018  
Date of Next Calibration<sup>(a)</sup> : Sep 27, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	3.97	-0.03	Satisfactory
7.42	7.40	-0.02	Satisfactory
10.01	10.00	-0.01	Satisfactory

Tolerance of pH should be less than ±0.10 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
12.6	12.3	-0.3	Satisfactory
37.4	37.5	0.1	Satisfactory
62.7	61.4	-1.3	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted form relevant international standards.
- <sup>(b)</sup> The results relate only to the calibrated equipment as received
- <sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.
- <sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.
- <sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted form relevant international standards.

APPROVED SIGNATORY:

LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060170  
Date of Issue : 28 June 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.02	0.02	Satisfactory
4.37	4.41	0.04	Satisfactory
5.96	6.12	0.16	Satisfactory
7.34	7.41	0.07	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	148.0	0.7	Satisfactory
0.01	1412	1438	1.8	Satisfactory
0.1	12890	12696	-1.5	Satisfactory
0.5	58670	57876	-1.4	Satisfactory
1.0	111900	111059	-0.8	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.99	-0.1	Satisfactory
20	20.09	0.4	Satisfactory
30	30.22	0.7	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.00	--	--
10	10.14	1.4	Satisfactory
20	20.30	1.5	Satisfactory
100	101.67	1.7	Satisfactory
800	818.83	2.4	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

Remark(s): -

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060002  
Date of Issue : 01 June 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI 6920 v2 (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 000109DF  
Date of Received : May 23, 2018  
Date of Calibration : May 23, 2018 to May 23, 2018  
Date of Next Calibration<sup>(a)</sup> : Aug 23, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,e)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.06	0.06	Satisfactory
7.42	7.46	0.04	Satisfactory
10.01	10.07	0.06	Satisfactory

Tolerance of pH should be less than ±0.10 (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
19.5	19.8	0.3	Satisfactory
26.4	26.2	-0.2	Satisfactory
38.5	38.8	0.3	Satisfactory

Tolerance limit of temperature should be less than ±2.0 (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.  
<sup>(b)</sup> The results relate only to the calibrated equipment as received  
<sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.  
<sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.  
<sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted from relevant international standards.

APPROVED SIGNATORY:

LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060002  
Date of Issue : 01 June 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.13	0.13	Satisfactory
2.98	3.06	0.08	Satisfactory
5.04	5.10	0.06	Satisfactory
6.78	6.83	0.05	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	142.5	-3.0	Satisfactory
0.01	1412	1384	-2.0	Satisfactory
0.1	12890	12116	-6.0	Satisfactory
0.5	58670	57188	-2.5	Satisfactory
1.0	111900	106439	-4.9	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.84	-1.6	Satisfactory
20	19.79	-1.1	Satisfactory
30	29.72	-0.9	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.1	--	--
10	10.7	7.0	Satisfactory
20	20.5	2.5	Satisfactory
100	98.6	-1.4	Satisfactory
800	788.6	-1.4	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

**Remark(s): -**

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060001  
Date of Issue : 01 June 2018  
Page No. : 1 of 2

### PART A – CUSTOMER INFORMATION

Enovative Environmental Service Ltd.  
Flat 2207, Yu Fun House,  
Yu Chui Court, Shatin  
New Territories, Hong Kong  
Attn: Mr. Thomas WONG

### PART B – DESCRIPTION

Name of Equipment : YSI 6920 v2 (Multi-Parameters)  
Manufacturer : YSI (a xylem brand)  
Serial Number : 0001C6A7  
Date of Received : May 23, 2018  
Date of Calibration : May 23, 2018 to May 23, 2018  
Date of Next Calibration<sup>(a)</sup> : Aug 23, 2018

### PART C – REFERENCE METHODS/ DOCUMENTS FOR THE CALIBRATION

Parameter	Reference Method
pH at 25°C	APHA 21e 4500-H <sup>+</sup> B
Dissolved Oxygen	APHA 21e 4500-O G
Conductivity at 25°C	APHA 21e 2510 B
Salinity	APHA 21e 2520 B
Turbidity	APHA 21e 2130 B
Temperature	Section 6 of international Accreditation New Zealand Technical Guide no. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

### PART D – CALIBRATION RESULTS<sup>(b,c)</sup>

#### (1) pH at 25°C

Target (pH unit)	Displayed Reading <sup>(d)</sup> (pH Unit)	Tolerance <sup>(e)</sup> (pH Unit)	Results
4.00	4.08	0.08	Satisfactory
7.42	7.48	0.06	Satisfactory
10.01	10.06	0.05	Satisfactory

Tolerance of pH should be less than  $\pm 0.10$  (pH unit)

#### (2) Temperature

Reading of Ref. thermometer (°C)	Displayed Reading (°C)	Tolerance (°C)	Results
19.5	19.7	0.2	Satisfactory
26.4	26.3	-0.1	Satisfactory
38.5	38.6	0.1	Satisfactory


Tolerance limit of temperature should be less than  $\pm 2.0$  (°C)

~ CONTINUED ON NEXT PAGE ~

#### Remark(s): -

- <sup>(a)</sup> The "Date of Next Calibration" is recommended according to best practice principals as practiced by QPT or quoted from relevant international standards.  
<sup>(b)</sup> The results relate only to the calibrated equipment as received  
<sup>(c)</sup> The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.  
<sup>(d)</sup> "Displayed Reading" denotes the figure shown on item under calibration/ checking regardless of equipment precision or significant figures.  
<sup>(e)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by QPT or quoted from relevant international standards.

APPROVED SIGNATORY:

  
LAM Ho-ye, Emma  
Assistant Laboratory Manager



專業化驗有限公司

QUALITY PRO TEST-CONSULT LIMITED

Unit 10, 14/F, Wah Wai Centre, 38-40 Au Pui Wan St., Fotan, Hong Kong

Email: info@qualityprotest.com; Website: www.qualityprotest.com

Tel: (852) 3956 8717; Fax: (852) 3956 3928

## REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Report No. : AH060001  
Date of Issue : 01 June 2018  
Page No. : 2 of 2

### PART D – CALIBRATION RESULTS (Cont'd)

#### (3) Dissolved Oxygen

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)	Results
0.00	0.11	0.11	Satisfactory
2.98	3.02	0.04	Satisfactory
5.04	5.15	0.11	Satisfactory
6.78	6.85	0.07	Satisfactory

Tolerance limit of dissolved oxygen should be less than  $\pm 0.20$  (mg/L)

#### (4) Conductivity at 25°C

Conc. of KCl (M)	Expected Reading ( $\mu\text{S}/\text{cm}$ )	Displayed Reading ( $\mu\text{S}/\text{cm}$ )	Tolerance (%)	Results
0.001	146.9	142.8	-2.8	Satisfactory
0.01	1412	1380	-2.3	Satisfactory
0.1	12890	12293	-4.6	Satisfactory
0.5	58670	57462	-2.1	Satisfactory
1.0	111900	109408	-2.2	Satisfactory

Tolerance limit of conductivity should be less than  $\pm 10.0$  (%)

#### (5) Salinity

Expected Reading (g/L)	Displayed Reading (g/L)	Tolerance (%)	Results
10	9.79	-2.1	Satisfactory
20	19.68	-1.6	Satisfactory
30	29.67	-1.1	Satisfactory

Tolerance limit of salinity should be less than  $\pm 10.0$  (%)

#### (6) Turbidity

Expected Reading (NTU)	Displayed Reading <sup>(f)</sup> (NTU)	Tolerance <sup>(g)</sup> (%)	Results
0	0.1	--	--
10	10.6	6.0	Satisfactory
20	20.7	3.5	Satisfactory
100	98.4	-1.6	Satisfactory
800	789.1	-1.4	Satisfactory

Tolerance limit of turbidity should be less than  $\pm 10.0$  (%)

~ END OF REPORT ~

#### Remark(s): -

<sup>(f)</sup> "Displayed Reading" presents the figures shown on item under calibration/ checking regardless of equipment precision or significant figures.

<sup>(g)</sup> The "Tolerance Limit" mentioned is the acceptance criteria applicable for similar equipment used by Quality Pro Test-Consult Ltd. or quoted from relevant international standards.





輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No. : C175727  
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC17-2277)      Date of Receipt / 收件日期 : 3 October 2017

Description / 儀器名稱 : Anemometer  
Manufacturer / 製造商 : Lutron  
Model No. / 型號 : AM-4201  
Serial No. / 編號 : AF.27513  
Supplied By / 委託者 : Envirotech Services Co.  
Room 113, 1/F, My Loft, 9 Hoi Wing Road, Tuen Mun,  
New Territories, Hong Kong

## TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C      Relative Humidity / 相對濕度 : (55 ± 20)%  
Line Voltage / 電壓 : ---

## TEST SPECIFICATIONS / 測試規範


Calibration check


DATE OF TEST / 測試日期 : 13 October 2017

## TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.  
The results are detailed in the subsequent page(s).


The test equipment used for calibration are traceable to National Standards via :  
- Testo Industrial Services GmbH, Germany

Tested By :   
測試 H C Chan  
Engineer

Certified By :   
核證 K C Lee  
Engineer

Date of Issue : 16 October 2017  
簽發日期

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.  
本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

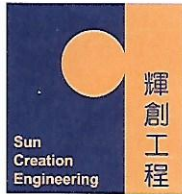

輝創工程有限公司

Sun Creation Engineering Limited

Calibration and Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No. : C175727

證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- The results presented are the mean of 10 measurements at each calibration point.
- Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL386	Multi-function Measuring Instrument	S16493

- Test procedure : MA130N.

- Results :

### Air Velocity

Applied Value (m/s)	UUT Reading (m/s)	Measured Correction		
		Value (m/s)	Measurement Uncertainty	
			Expanded Uncertainty (m/s)	Coverage Factor
1.9	1.7	+0.2	0.2	2.0
4.0	3.8	+0.2	0.2	2.0
6.0	5.9	+0.1	0.3	2.0
8.0	8.0	0.0	0.3	2.0
10.0	10.1	-0.1	0.4	2.0

Remarks : - The Measured Corrections are defined as :  
Value = Applied Value - UUT Reading

- The expanded uncertainties are for a level of confidence of 95 %.

### Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部深印本證書需先獲本實驗室書面批准。

Sun Creation Engineering Limited Calibration & Testing Laboratory

c/o 4F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong

輝創工程有限公司 校正及檢測實驗室

c/o 香港新界屯門興安里一號青山灣機樓四樓

Tel 電話: 2927 2606

Fax 傳真: 2744 8986

E-mail 電郵: callab@suncreation.com

Website 網址: www.suncreation.com

**ENVIROTECH SERVICES CO.**

**Calibration Report of Wind Meter**

Date of Calibration : 01 April 2018

Brand of Test Meter: Global Water

Model: Speed Sensor: WE550 (S/N:E1337005099 )

Direction Sensor: WE570 (S/N:153500564)

Location : Pak Mong, Siu Ho Wan

Procedures :

- 1. Wind Still Test: The wind speed sensor was hold by hand until it keep still
- 2. Wind Speed Test: The wind meter was on-site calibrated against the Anemometer
- 3. Wind Direction Test : The wind meter was on-site calibrated against the marine compass at four directions

Results:

Wind Still Test


Wind Speed (m/s)
0.00


Wind Speed Test

Global Wate: (m/s)	Anemometer (m/s)
1.71	1.6
1.19	1.1
0.47	0.4

Wind Direction Test

Global Wate: (o)	Marine Compass (o)
271.10	270
0.04	0
90.25	90
180.66	180

Calibrated by:   
Yeung Ping Fai  
(Technical Officer)

Checked by :   
Ho Kam Fat  
(Senior Technical Officer)

Appendix F

## EM&A Monitoring Schedules

**HY/2012/07 Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Noise Monitoring Schedule (1 to 31 July 2018)**

Alternative Noise Monitoring at Pak Mong Village Entrance

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
01-Jul	02-Jul	03-Jul	04-Jul	05-Jul	06-Jul	07-Jul
		Noise Impact Monitoring				
08-Jul	09-Jul	10-Jul	11-Jul	12-Jul	13-Jul	14-Jul
	Noise Impact Monitoring			Noise Impact Monitoring		
15-Jul	16-Jul	17-Jul	18-Jul	19-Jul	20-Jul	21-Jul
			Noise Impact Monitoring			
22-Jul	23-Jul	24-Jul	25-Jul	26-Jul	27-Jul	28-Jul
		Noise Impact Monitoring				
29-Jul	30-Jul	31-Jul				
	Noise Impact Monitoring					

**HY/2012/07 Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Air Quality Monitoring Schedule (1 to 31 July 2018)**

Alternative Air Quality Monitoring at WA4 and MTRC Depot Entrance

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
01-Jul	02-Jul	03-Jul	04-Jul	05-Jul	06-Jul	07-Jul
		1-hr TSP Monitoring 24-hr TSP Monitoring				
08-Jul	09-Jul	10-Jul	11-Jul	12-Jul	13-Jul	14-Jul
	1-hr TSP Monitoring 24-hr TSP Monitoring			1-hr TSP Monitoring 24-hr TSP Monitoring		
15-Jul	16-Jul	17-Jul	18-Jul	19-Jul	20-Jul	21-Jul
			1-hr TSP Monitoring 24-hr TSP Monitoring			
22-Jul	23-Jul	24-Jul	25-Jul	26-Jul	27-Jul	28-Jul
		1-hr TSP Monitoring 24-hr TSP Monitoring				
29-Jul	30-Jul	31-Jul				01-Jan
	1-hr TSP Monitoring 24-hr TSP Monitoring					

**HY/2012/07 Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Noise Monitoring Schedule (1 to 31 August 2018)**

Alternative Noise Monitoring at Pak Mong Village Entrance

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			01-Aug	02-Aug	03-Aug	04-Aug
				Noise Impact Monitoring		
05-Aug	06-Aug	07-Aug	08-Aug	09-Aug	10-Aug	11-Aug
			Noise Impact Monitoring			
12-Aug	13-Aug	14-Aug	15-Aug	16-Aug	17-Aug	18-Aug
		Noise Impact Monitoring				
19-Aug	20-Aug	21-Aug	22-Aug	23-Aug	24-Aug	25-Aug
	Noise Impact Monitoring			Noise Impact Monitoring		
26-Aug	27-Aug	28-Aug	29-Aug	30-Aug	31-Aug	
			Noise Impact Monitoring			

The schedule is subject to agreement from the EPD on the monitoring times. The schedule will be revised after reviewing the progress of the construction works or due to adverse (safety, weather etc) conditions. Additional weekly noise impact monitoring for construction works undertaken between 19:00-07:00 will be supplemented after confirmation of construction schedule.

**HY/2012/07 Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Air Quality Monitoring Schedule (1 to 31 August 2018)**

Alternative Air Quality Monitoring at WA4 and MTRC Depot Entrance

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			01-Aug	02-Aug	03-Aug	04-Aug
				1-hr TSP Monitoring 24-hr TSP Monitoring		
05-Aug	06-Aug	07-Aug	08-Aug	09-Aug	10-Aug	11-Aug
			1-hr TSP Monitoring 24-hr TSP Monitoring			
12-Aug	13-Aug	14-Aug	15-Aug	16-Aug	17-Aug	18-Aug
		1-hr TSP Monitoring 24-hr TSP Monitoring				
19-Aug	20-Aug	21-Aug	22-Aug	23-Aug	24-Aug	25-Aug
	1-hr TSP Monitoring 24-hr TSP Monitoring			1-hr TSP Monitoring 24-hr TSP Monitoring		
26-Aug	27-Aug	28-Aug	29-Aug	30-Aug	31-Aug	
			1-hr TSP Monitoring 24-hr TSP Monitoring			

The schedule is subject to agreement from the EPD on the monitoring times. The schedule will be revised after reviewing the progress of the construction works or due to adverse (safety, weather etc) conditions.

**HY/2012/07 - Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Marine Water Quality Monitoring (WQM) Schedule (July 2018)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1-Jul	2-Jul	3-Jul	4-Jul	5-Jul	6-Jul	7-Jul
	ebb tide 13:47 - 17:17 flood tide 6:51 - 10:21		ebb tide 15:03 - 18:33 flood tide 8:17 - 11:47		ebb tide 16:41 - 20:11 flood tide 10:31 - 14:01	
8-Jul	9-Jul	10-Jul	11-Jul	12-Jul	13-Jul	14-Jul
	ebb tide 8:10 - 11:40 flood tide 14:37 - 18:07		ebb tide 9:46 - 13:16 flood tide 16:45 - 20:15		ebb tide 11:21 - 14:51 flood tide 18:31 - 22:01	
15-Jul	16-Jul	17-Jul	18-Jul	19-Jul	20-Jul	21-Jul
	ebb tide 13:47 - 17:17 flood tide 6:50 - 10:20		ebb tide 15:27 - 18:57 flood tide 8:44 - 12:14 WQM during mid-flood tide was canceled due to adverse weather		ebb tide 17:26 - 20:56 flood tide 11:20 - 14:50	
22-Jul	23-Jul	24-Jul	25-Jul	26-Jul	27-Jul	28-Jul
	ebb tide 8:38 - 12:08 flood tide 15:43 - 19:13		ebb tide 10:00 - 13:30 flood tide 17:13 - 20:43		ebb tide 11:12 - 14:42 flood tide 18:21 - 21:51	
29-Jul	30-Jul	31-Jul				
	ebb tide 12:51 - 16:21 flood tide 6:02 - 9:32					

**HY/2012/07 - Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Marine Water Quality Monitoring (WQM) Schedule (August 2018)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			1-Aug	2-Aug	3-Aug	4-Aug
			ebb tide 13:56 - 17:26 flood tide 7:21 - 10:51		ebb tide 15:11 - 18:41 flood tide 8:58 - 12:28	
5-Aug	6-Aug	7-Aug	8-Aug	9-Aug	10-Aug	11-Aug
	ebb tide 6:27 - 9:57 flood tide 13:03 - 16:33		ebb tide 8:34 - 12:04 flood tide 15:46 - 19:16		ebb tide 10:20 - 13:50 flood tide 17:29 - 20:59	
12-Aug	13-Aug	14-Aug	15-Aug	16-Aug	17-Aug	18-Aug
	ebb tide 12:44 - 16:14 flood tide 5:55 - 9:25		ebb tide 14:13 - 17:43 flood tide 7:38 - 11:08		ebb tide 15:42 - 19:12 flood tide 9:35 - 13:05	
19-Aug	20-Aug	21-Aug	22-Aug	23-Aug	24-Aug	25-Aug
	ebb tide 6:58 - 10:28 flood tide 14:34 - 18:04		ebb tide 8:56 - 12:26 flood tide 16:24 - 19:54		ebb tide 10:14 - 13:44 flood tide 17:23 - 20:53	
26-Aug	27-Aug	28-Aug	29-Aug	30-Aug	31-Aug	
	ebb tide 11:55 - 15:25 flood tide 5:14 - 8:44		ebb tide 12:55 - 16:25 flood tide 6:32 - 10:02		ebb tide 14:03 - 17:33 flood tide 7:57 - 11:27	

The schedule is subject to agreement from the EPD on the monitoring times. The schedule will be revised after reviewing the progress of the construction works or due to adverse (safety, weather etc) conditions.



**HY/2012/07 Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Dolphin Monitoring Survey Schedule (1 to 31 July 2018)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
01-Jul	02-Jul	03-Jul	04-Jul	05-Jul	06-Jul	07-Jul
		Impact Dolphin Monitoring				
08-Jul	09-Jul	10-Jul	11-Jul	12-Jul	13-Jul	14-Jul
	Impact Dolphin Monitoring			Impact Dolphin Monitoring		
15-Jul	16-Jul	17-Jul	18-Jul	19-Jul	20-Jul	21-Jul
					Impact Dolphin Monitoring	
22-Jul	23-Jul	24-Jul	25-Jul	26-Jul	27-Jul	28-Jul
29-Jul	30-Jul	31-Jul				

**HY/2012/07 Tuen Mun - Chek Lap Kok Link - Southern Connection Viaduct Section  
Impact Dolphin Monitoring Survey Schedule (1 to 31 August 2018)**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			01-Aug	02-Aug	03-Aug	04-Aug
			Impact Dolphin Monitoring			
05-Aug	06-Aug	07-Aug	08-Aug	09-Aug	10-Aug	11-Aug
			Impact Dolphin Monitoring			
12-Aug	13-Aug	14-Aug	15-Aug	16-Aug	17-Aug	18-Aug
	Impact Dolphin Monitoring		Impact Dolphin Monitoring			
19-Aug	20-Aug	21-Aug	22-Aug	23-Aug	24-Aug	25-Aug
26-Aug	27-Aug	28-Aug	29-Aug	30-Aug	31-Aug	

The schedule is subject to agreement from the EPD on the monitoring times. The schedule will be revised after reviewing the progress of the construction works or due to adverse (safety, weather etc) conditions.

Appendix G

Impact Air Quality  
Monitoring Results and  
Graphical Presentation

## 1-hour TSP Monitoring Results at Air Quality Monitoring Station ASR8A

Project	Works	Date(yyyy-mm-dd)	Station	Time (hh:mm, 24hour)	Parameter	Results (ug/m3)	Action Level (ug/m3)	Limit Level (ug/m3)		
TMCLKL	HY/2012/07	2018-07-03	ASR8A	8:25	1-hr TSP	66	394	500		
TMCLKL	HY/2012/07	2018-07-03	ASR8A	9:27	1-hr TSP	64				
TMCLKL	HY/2012/07	2018-07-03	ASR8A	10:30	1-hr TSP	78				
TMCLKL	HY/2012/07	2018-07-09	ASR8A	8:00	1-hr TSP	68				
TMCLKL	HY/2012/07	2018-07-09	ASR8A	9:02	1-hr TSP	58				
TMCLKL	HY/2012/07	2018-07-09	ASR8A	10:10	1-hr TSP	48				
TMCLKL	HY/2012/07	2018-07-12	ASR8A	8:00	1-hr TSP	21				
TMCLKL	HY/2012/07	2018-07-12	ASR8A	9:02	1-hr TSP	46				
TMCLKL	HY/2012/07	2018-07-12	ASR8A	10:14	1-hr TSP	31				
TMCLKL	HY/2012/07	2018-07-18	ASR8A	8:02	1-hr TSP	47				
TMCLKL	HY/2012/07	2018-07-18	ASR8A	9:04	1-hr TSP	56				
TMCLKL	HY/2012/07	2018-07-18	ASR8A	10:10	1-hr TSP	53				
TMCLKL	HY/2012/07	2018-07-24	ASR8A	8:30	1-hr TSP	60				
TMCLKL	HY/2012/07	2018-07-24	ASR8A	9:32	1-hr TSP	28				
TMCLKL	HY/2012/07	2018-07-24	ASR8A	10:45	1-hr TSP	21				
TMCLKL	HY/2012/07	2018-07-30	ASR8A	8:00	1-hr TSP	63				
TMCLKL	HY/2012/07	2018-07-30	ASR8A	9:02	1-hr TSP	36				
TMCLKL	HY/2012/07	2018-07-30	ASR8A	10:11	1-hr TSP	19				
				Average		48				
				Min.		19				
				Max.		78				

## 1-hour TSP Monitoring Results at Air Quality Monitoring Station ASR9



Project	Works	Date(yyyy-mm-dd)	Station	Time (hh:mm, 24hour)	Parameter	Results (ug/m3)	Action Level (ug/m3)	Limit Level (ug/m3)		
TMCLKL	HY/2012/07	2018-07-03	ASR9	8:35	1-hr TSP	108	393	500		
TMCLKL	HY/2012/07	2018-07-03	ASR9	9:37	1-hr TSP	58				
TMCLKL	HY/2012/07	2018-07-03	ASR9	10:41	1-hr TSP	63				
TMCLKL	HY/2012/07	2018-07-09	ASR9	8:12	1-hr TSP	79				
TMCLKL	HY/2012/07	2018-07-09	ASR9	9:14	1-hr TSP	60				
TMCLKL	HY/2012/07	2018-07-09	ASR9	10:20	1-hr TSP	55				
TMCLKL	HY/2012/07	2018-07-12	ASR9	8:11	1-hr TSP	30				
TMCLKL	HY/2012/07	2018-07-12	ASR9	9:13	1-hr TSP	34				
TMCLKL	HY/2012/07	2018-07-12	ASR9	10:25	1-hr TSP	50				
TMCLKL	HY/2012/07	2018-07-18	ASR9	8:14	1-hr TSP	54				
TMCLKL	HY/2012/07	2018-07-18	ASR9	9:16	1-hr TSP	44				
TMCLKL	HY/2012/07	2018-07-18	ASR9	10:22	1-hr TSP	58				
TMCLKL	HY/2012/07	2018-07-24	ASR9	8:42	1-hr TSP	70				
TMCLKL	HY/2012/07	2018-07-24	ASR9	9:44	1-hr TSP	34				
TMCLKL	HY/2012/07	2018-07-24	ASR9	10:57	1-hr TSP	17				
TMCLKL	HY/2012/07	2018-07-30	ASR9	8:13	1-hr TSP	59				
TMCLKL	HY/2012/07	2018-07-30	ASR9	9:15	1-hr TSP	42				
TMCLKL	HY/2012/07	2018-07-30	ASR9	10:22	1-hr TSP	43				
				Average		53				
				Min.		17				
				Max.		108				

**24-hour TSP Monitoring Results at Air Quality Monitoring Station ASR8A**

Project	Works	Date(yyyy-mm-dd)	Station	Time (hh:mm, 24hour)	Parameter	Results (ug/m3)	Action Level (ug/m3)	Limit Level (ug/m3)
TMCLKL	HY/2012/07	2018-07-03	ASR8A	11:32	24-hr TSP	32	178	260
TMCLKL	HY/2012/07	2018-07-09	ASR8A	11:12	24-hr TSP	27		
TMCLKL	HY/2012/07	2018-07-12	ASR8A	11:16	24-hr TSP	18		
TMCLKL	HY/2012/07	2018-07-18	ASR8A	11:12	24-hr TSP	28		
TMCLKL	HY/2012/07	2018-07-24	ASR8A	11:47	24-hr TSP	31		
TMCLKL	HY/2012/07	2018-07-30	ASR8A	11:13	24-hr TSP	29		
						Average	28	
						Min.	18	
						Max.	32	



**24-hour TSP Monitoring Results at Air Quality Monitoring Station ASR9**

Project	Works	Date(yyyy-mm-dd)	Station	Time (hh:mm, 24hour)	Parameter	Results (ug/m3)	Action Level (ug/m3)	Limit Level (ug/m3)
TMCLKL	HY/2012/07	2018-07-03	ASR9	11:43	24-hr TSP	44	178	260
TMCLKL	HY/2012/07	2018-07-09	ASR9	11:22	24-hr TSP	31		
TMCLKL	HY/2012/07	2018-07-12	ASR9	11:27	24-hr TSP	21		
TMCLKL	HY/2012/07	2018-07-18	ASR9	11:24	24-hr TSP	28		
TMCLKL	HY/2012/07	2018-07-24	ASR9	11:59	24-hr TSP	33		
TMCLKL	HY/2012/07	2018-07-30	ASR9	11:24	24-hr TSP	28		
						Average	31	
						Min.	21	
						Max.	44	

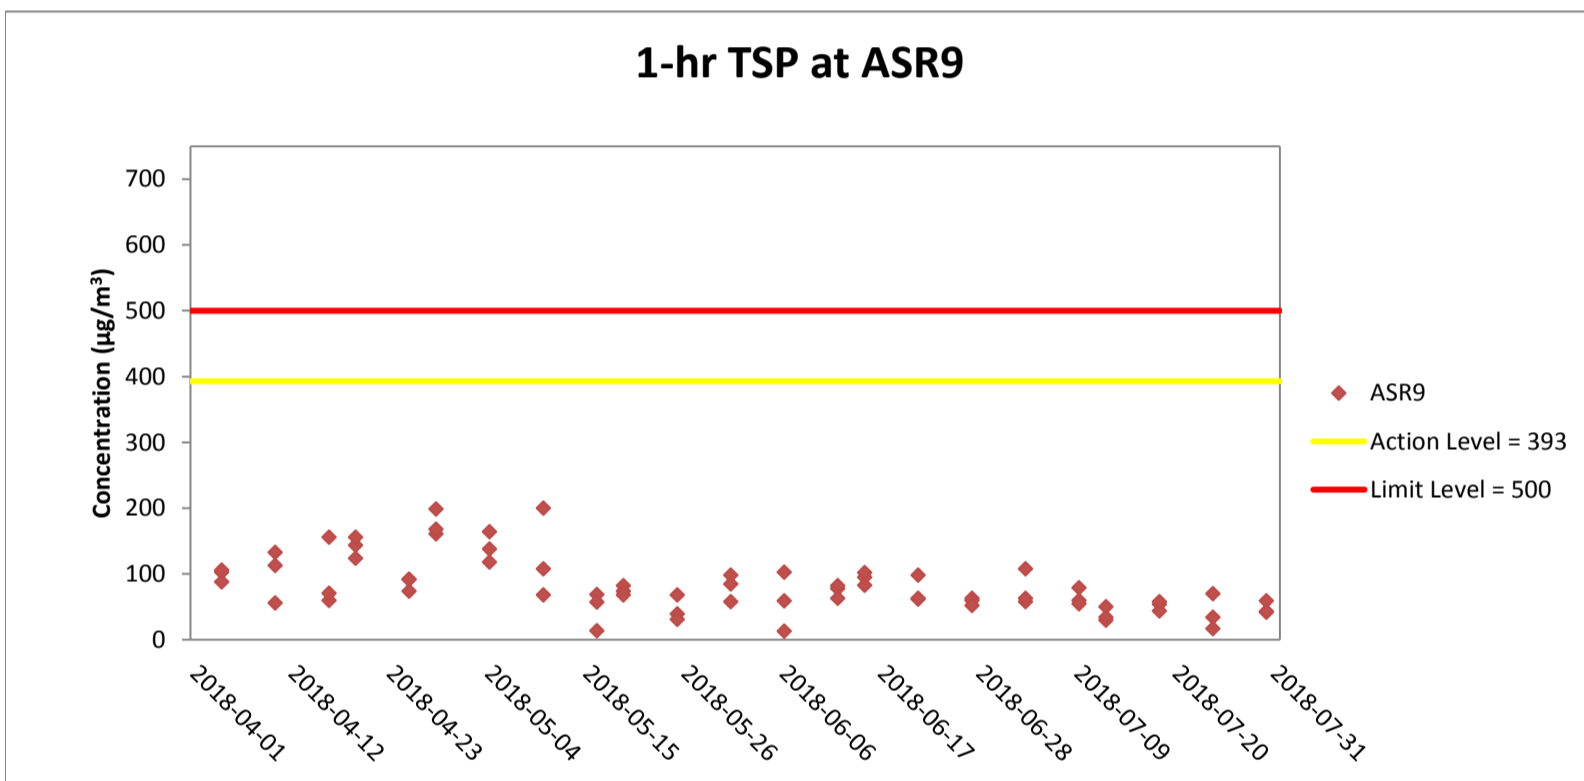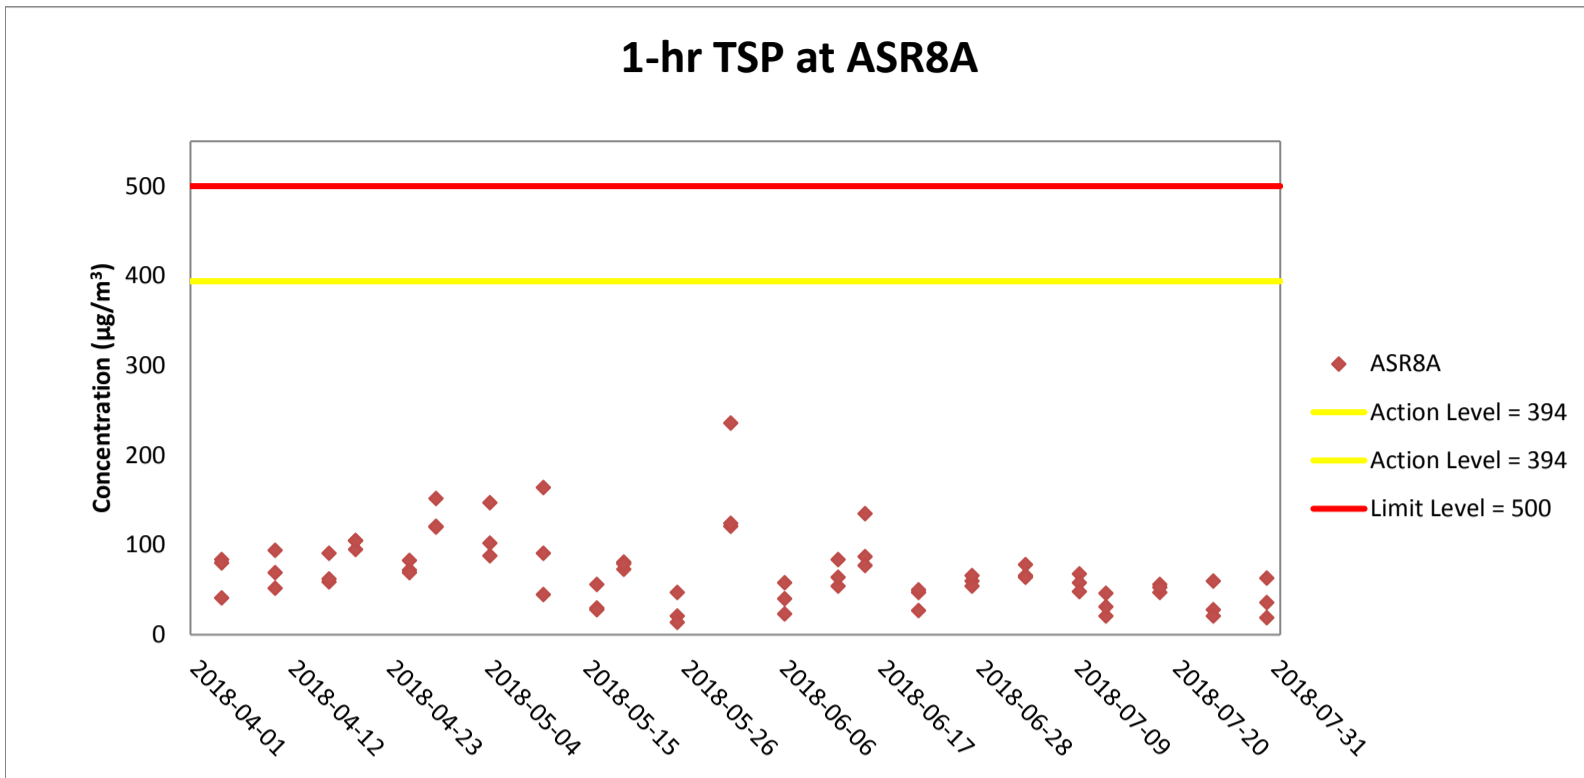

Weather condition within the reporting period varied between sunny to rainy.

Major construction works undertaken within the reporting period include Pier construction; Re-alignment of Cheung Tung Road; Road works along North Lantau Highway; Installation of pier head and deck segments; Asphalt paving; Sign gantries construction; Parapet installation; and Slope work of Viaducts A, B, C & D.

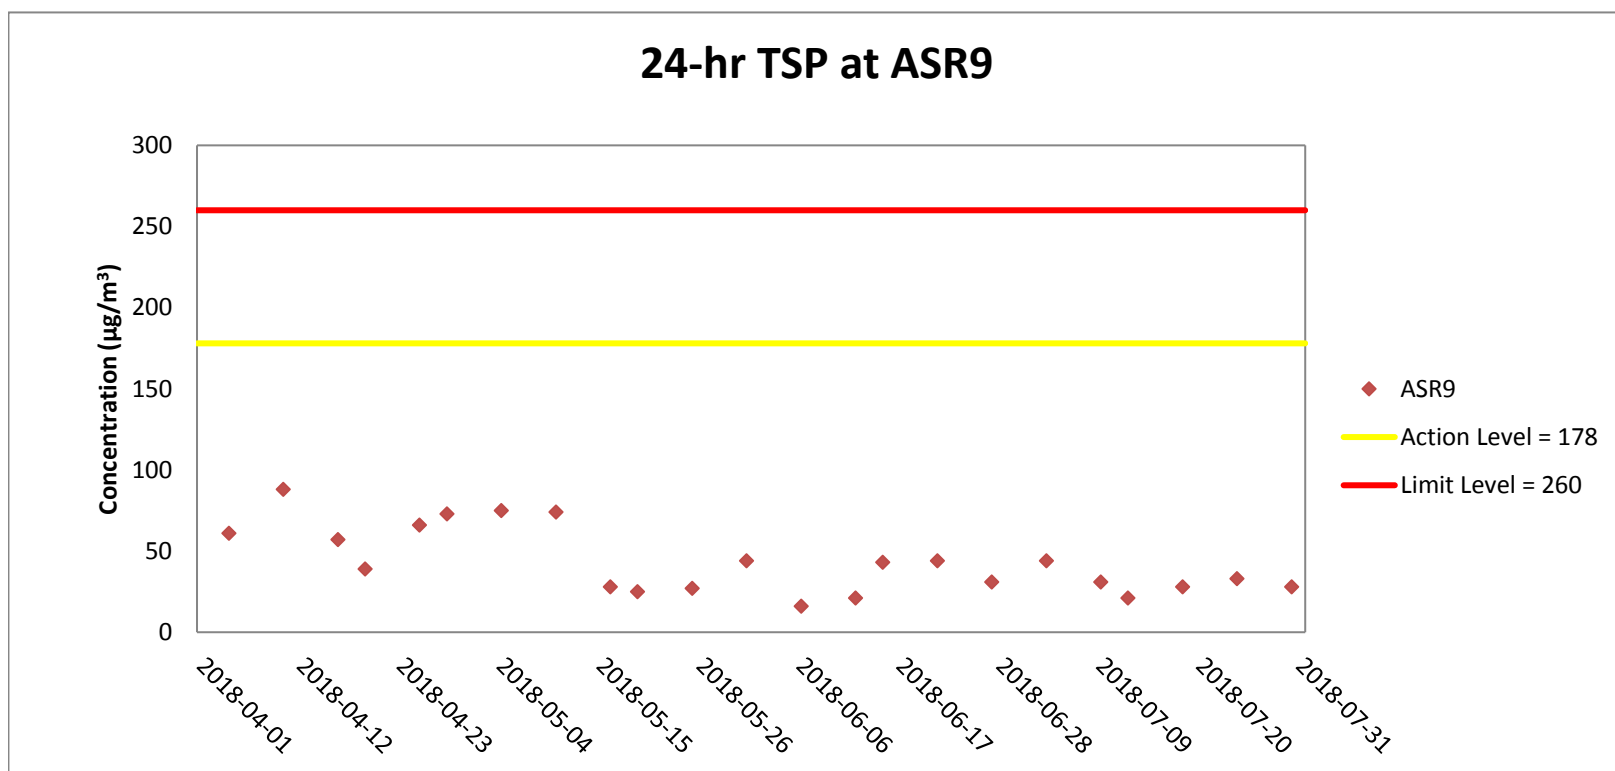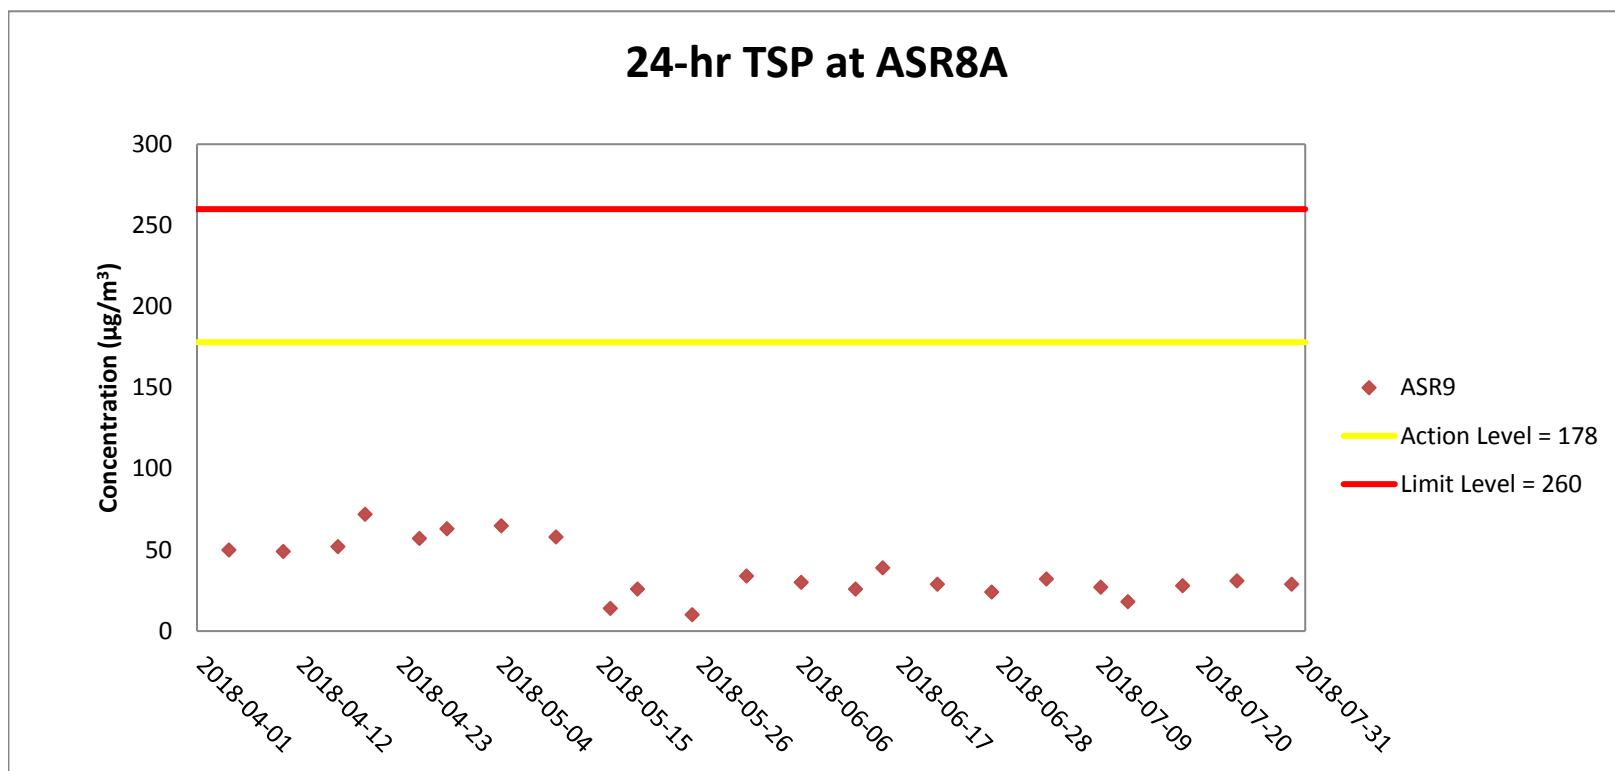

Weather condition within the reporting period varied between sunny to rainy.

Major construction works undertaken within the reporting period include Pier construction; Re-alignment of Cheung Tung Road; Road works along North Lantau Highway; Installation of pier head and deck segments; Asphalt paving; Sign gantries construction; Parapet installation; and Slope work of Viaducts A, B,C & D.

Appendix H

## Meteorological Data for the Reporting Month



Date	Time (HH)	Wind speed (m/s)	Wind direction (deg)
2018/7/3	0	1.35	187
2018/7/3	1	0.83	194
2018/7/3	2	0.02	196
2018/7/3	3	0.64	189
2018/7/3	4	0.03	169
2018/7/3	5	0.09	186
2018/7/3	6	0.76	201
2018/7/3	7	0.66	203
2018/7/3	8	0.06	135
2018/7/3	9	0.24	210
2018/7/3	10	1.93	240
2018/7/3	11	1.87	240
2018/7/3	12	1.36	230
2018/7/3	13	2.93	242
2018/7/3	14	2.07	227
2018/7/3	15	1.70	225
2018/7/3	16	2.05	205
2018/7/3	17	2.51	208
2018/7/3	18	1.86	208
2018/7/3	19	1.67	209
2018/7/3	20	2.24	225
2018/7/3	21	1.75	218
2018/7/3	22	2.57	213
2018/7/3	23	2.44	210
2018/7/4	0	0.72	211
2018/7/4	1	2.27	242
2018/7/4	2	1.49	228
2018/7/4	3	1.34	219
2018/7/4	4	1.40	240
2018/7/4	5	2.07	226
2018/7/4	6	1.29	239
2018/7/4	7	1.39	234
2018/7/4	8	0.99	243
2018/7/4	9	1.18	258
2018/7/4	10	2.25	231
2018/7/4	11	1.55	240
2018/7/4	12	2.93	224
2018/7/4	13	2.12	232
2018/7/4	14	1.79	235
2018/7/4	15	3.69	206
2018/7/4	16	4.15	204
2018/7/4	17	3.40	214
2018/7/4	18	2.72	217
2018/7/4	19	3.18	207
2018/7/4	20	2.34	206
2018/7/4	21	1.90	210
2018/7/4	22	1.83	203
2018/7/4	23	1.70	205
2018/7/9	0	0.78	191
2018/7/9	1	0.20	172
2018/7/9	2	0.02	170
2018/7/9	3	0.02	217
2018/7/9	4	0.03	176
2018/7/9	5	0.02	106
2018/7/9	6	0.16	173
2018/7/9	7	0.10	198
2018/7/9	8	0.12	161
2018/7/9	9	0.89	209
2018/7/9	10	2.01	200
2018/7/9	11	0.75	201
2018/7/9	12	0.84	173
2018/7/9	13	0.91	181
2018/7/9	14	0.98	196
2018/7/9	15	0.46	221
2018/7/9	16	1.66	213
2018/7/9	17	2.07	189
2018/7/9	18	0.58	181
2018/7/9	19	0.05	111
2018/7/9	20	0.09	137
2018/7/9	21	0.34	144
2018/7/9	22	0.03	124
2018/7/9	23	0.03	100

Date	Time (HH)	Wind speed (m/s)	Wind direction (deg)
2018/7/10	0	0.05	124
2018/7/10	1	0.02	130
2018/7/10	2	0.02	106
2018/7/10	3	0.02	104
2018/7/10	4	0.02	117
2018/7/10	5	0.04	200
2018/7/10	6	0.03	225
2018/7/10	7	0.02	169
2018/7/10	8	0.02	161
2018/7/10	9	0.02	197
2018/7/10	10	0.90	202
2018/7/10	11	0.83	222
2018/7/10	12	1.54	188
2018/7/10	13	2.03	208
2018/7/10	14	3.49	218
2018/7/10	15	3.80	221
2018/7/10	16	4.27	225
2018/7/10	17	2.86	212
2018/7/10	18	3.72	211
2018/7/10	19	2.79	208
2018/7/10	20	1.02	198
2018/7/10	21	0.74	215
2018/7/10	22	1.52	193
2018/7/10	23	1.64	201
2018/7/12	0	2.83	209
2018/7/12	1	0.22	182
2018/7/12	2	0.11	183
2018/7/12	3	0.31	183
2018/7/12	4	0.62	189
2018/7/12	5	0.10	214
2018/7/12	6	0.02	212
2018/7/12	7	0.69	183
2018/7/12	8	1.25	194
2018/7/12	9	2.28	216
2018/7/12	10	1.36	217
2018/7/12	11	1.58	209
2018/7/12	12	1.38	212
2018/7/12	13	0.79	195
2018/7/12	14	1.52	194
2018/7/12	15	1.89	208
2018/7/12	16	1.68	190
2018/7/12	17	1.02	197
2018/7/12	18	0.65	189
2018/7/12	19	0.76	201
2018/7/12	20	0.13	134
2018/7/12	21	0.07	194
2018/7/12	22	0.56	198
2018/7/12	23	0.49	188
2018/7/13	0	0.08	135
2018/7/13	1	0.12	106
2018/7/13	2	0.04	199
2018/7/13	3	0.15	152
2018/7/13	4	0.86	191
2018/7/13	5	0.16	192
2018/7/13	6	0.10	124
2018/7/13	7	0.45	153
2018/7/13	8	0.24	163
2018/7/13	9	0.09	117
2018/7/13	10	0.02	131
2018/7/13	11	0.11	108
2018/7/13	12	0.68	207
2018/7/13	13	1.03	208
2018/7/13	14	0.73	213
2018/7/13	15	0.42	194
2018/7/13	16	0.44	143
2018/7/13	17	0.26	188
2018/7/13	18	0.18	156
2018/7/13	19	0.03	123
2018/7/13	20	0.02	126
2018/7/13	21	0.02	113
2018/7/13	22	0.06	112
2018/7/13	23	0.28	176

Date	Time (HH)	Wind speed (m/s)	Wind direction (deg)
2018/7/18	0	0.39	146
2018/7/18	1	0.99	163
2018/7/18	2	2.03	195
2018/7/18	3	0.37	173
2018/7/18	4	0.07	171
2018/7/18	5	0.12	119
2018/7/18	6	0.08	137
2018/7/18	7	0.07	170
2018/7/18	8	0.61	181
2018/7/18	9	0.46	140
2018/7/18	10	0.22	153
2018/7/18	11	0.19	134
2018/7/18	12	0.49	188
2018/7/18	13	0.88	209
2018/7/18	14	0.56	164
2018/7/18	15	0.62	175
2018/7/18	16	0.29	126
2018/7/18	17	0.44	101
2018/7/18	18	0.45	98
2018/7/18	19	0.74	173
2018/7/18	20	0.35	161
2018/7/18	21	0.29	165
2018/7/18	22	0.58	156
2018/7/18	23	0.45	162
2018/7/19	0	0.06	155
2018/7/19	1	0.03	144
2018/7/19	2	0.14	119
2018/7/19	3	0.06	143
2018/7/19	4	0.17	115
2018/7/19	5	0.04	150
2018/7/19	6	0.07	240
2018/7/19	7	0.17	142
2018/7/19	8	0.04	183
2018/7/19	9	0.30	194
2018/7/19	10	1.48	156
2018/7/19	11	1.84	190
2018/7/19	12	2.16	184
2018/7/19	13	2.26	194
2018/7/19	14	3.24	192
2018/7/19	15	0.44	182
2018/7/19	16	1.44	169
2018/7/19	17	0.46	154
2018/7/19	18	0.34	160
2018/7/19	19	0.49	161
2018/7/19	20	0.04	106
2018/7/19	21	0.36	133
2018/7/19	22	0.08	149
2018/7/19	23	0.67	171
2018/7/24	0	0.74	217
2018/7/24	1	2.07	183
2018/7/24	2	1.81	182
2018/7/24	3	1.37	167
2018/7/24	4	1.16	174
2018/7/24	5	1.50	178
2018/7/24	6	1.81	172
2018/7/24	7	2.17	185
2018/7/24	8	2.28	202
2018/7/24	9	2.58	190
2018/7/24	10	3.34	191
2018/7/24	11	1.90	192
2018/7/24	12	1.81	175
2018/7/24	13	0.76	188
2018/7/24	14	0.94	166
2018/7/24	15	2.23	198
2018/7/24	16	1.06	175
2018/7/24	17	2.03	172
2018/7/24	18	2.06	178
2018/7/24	19	2.15	202
2018/7/24	20	1.33	195
2018/7/24	21	0.77	166
2018/7/24	22	0.65	175
2018/7/24	23	0.45	173

Date	Time (HH)	Wind speed (m/s)	Wind direction (deg)
2018/7/25	0	0.51	183
2018/7/25	1	0.90	188
2018/7/25	2	0.54	187
2018/7/25	3	0.71	170
2018/7/25	4	0.47	193
2018/7/25	5	0.32	161
2018/7/25	6	1.24	175
2018/7/25	7	1.60	170
2018/7/25	8	1.38	204
2018/7/25	9	1.37	161
2018/7/25	10	2.02	194
2018/7/25	11	2.52	194
2018/7/25	12	3.34	196
2018/7/25	13	3.50	192
2018/7/25	14	2.29	204
2018/7/25	15	2.72	199
2018/7/25	16	2.66	198
2018/7/25	17	1.60	183
2018/7/25	18	0.76	167
2018/7/25	19	0.34	167
2018/7/25	20	0.50	156
2018/7/25	21	0.17	171
2018/7/25	22	0.02	154
2018/7/25	23	0.05	187
2018/7/30	0	0.35	194
2018/7/30	1	0.54	196
2018/7/30	2	0.32	201
2018/7/30	3	0.11	203
2018/7/30	4	0.07	203
2018/7/30	5	0.31	199
2018/7/30	6	0.07	190
2018/7/30	7	0.02	199
2018/7/30	8	0.02	271
2018/7/30	9	0.26	216
2018/7/30	10	0.58	197
2018/7/30	11	0.02	237
2018/7/30	12	0.02	355
2018/7/30	13	0.26	298
2018/7/30	14	2.40	183
2018/7/30	15	2.69	188
2018/7/30	16	2.28	185
2018/7/30	17	1.80	197
2018/7/30	18	1.20	177
2018/7/30	19	0.29	177
2018/7/30	20	0.34	199
2018/7/30	21	0.06	167
2018/7/30	22	0.17	191
2018/7/30	23	0.03	198
2018/7/31	0	0.02	204
2018/7/31	1	0.02	170
2018/7/31	2	0.02	199
2018/7/31	3	0.06	189
2018/7/31	4	0.03	197
2018/7/31	5	0.02	188
2018/7/31	6	0.02	199
2018/7/31	7	0.02	188
2018/7/31	8	0.02	217
2018/7/31	9	0.02	351
2018/7/31	10	0.02	329
2018/7/31	11	0.18	154
2018/7/31	12	1.46	161
2018/7/31	13	3.02	189
2018/7/31	14	0.91	225
2018/7/31	15	0.41	218
2018/7/31	16	0.79	210
2018/7/31	17	0.92	201
2018/7/31	18	0.11	168
2018/7/31	19	0.03	175
2018/7/31	20	0.11	187
2018/7/31	21	0.02	191
2018/7/31	22	0.23	198
2018/7/31	23	0.09	189


Appendix I

Impact Noise Monitoring  
Results and Graphical  
Presentation

Appendix I-1 Noise Monitoring Results

Project	Works	Date (yyyy-mm-dd)	Station	Weather Condition	Time (hh:mm, 24hour)	Noise Level for 30-min, dB(A)			Limit Level dB(A)	Wind Speed (m/s)	Noise Meter Model/ID	Calibrator Model/ID
						Leq	L10	L90				
TMCLKL	HY/2012/07	2018-07-03	NSR1A	Sunny	9:48	64	66	61	75	0.2	RION NL52 (00131628)	RION NC73 (S/N 10486660)
TMCLKL	HY/2012/07	2018-07-09	NSR1A	Sunny	9:31	64	64	60	75	0.4	RION NL52 (00131628)	RION NC73 (S/N 10486660)
TMCLKL	HY/2012/07	2018-07-12	NSR1A	Sunny	9:30	64	65	60	75	0.5	RION NL52 (00131628)	RION NC73 (S/N 10486660)
TMCLKL	HY/2012/07	2018-07-18	NSR1A	Cloudy	9:28	65	65	62	75	1.5	RION NL52 (00131628)	RION NC73 (S/N 10486660)
TMCLKL	HY/2012/07	2018-07-24	NSR1A	Cloudy	10:05	65	65	61	75	1.5	RION NL52 (00131628)	RION NC73 (S/N 10486660)
TMCLKL	HY/2012/07	2018-07-30	NSR1A	Sunny	9:28	62	64	60	75	0.3	RION NL52 (00131628)	RION NC73 (S/N 10486660)
						Min.	62					
						Max.	65					
						Average	64					

### Noise Monitoring Results at NSR 1A ( $L_{eq, 30min}$ )

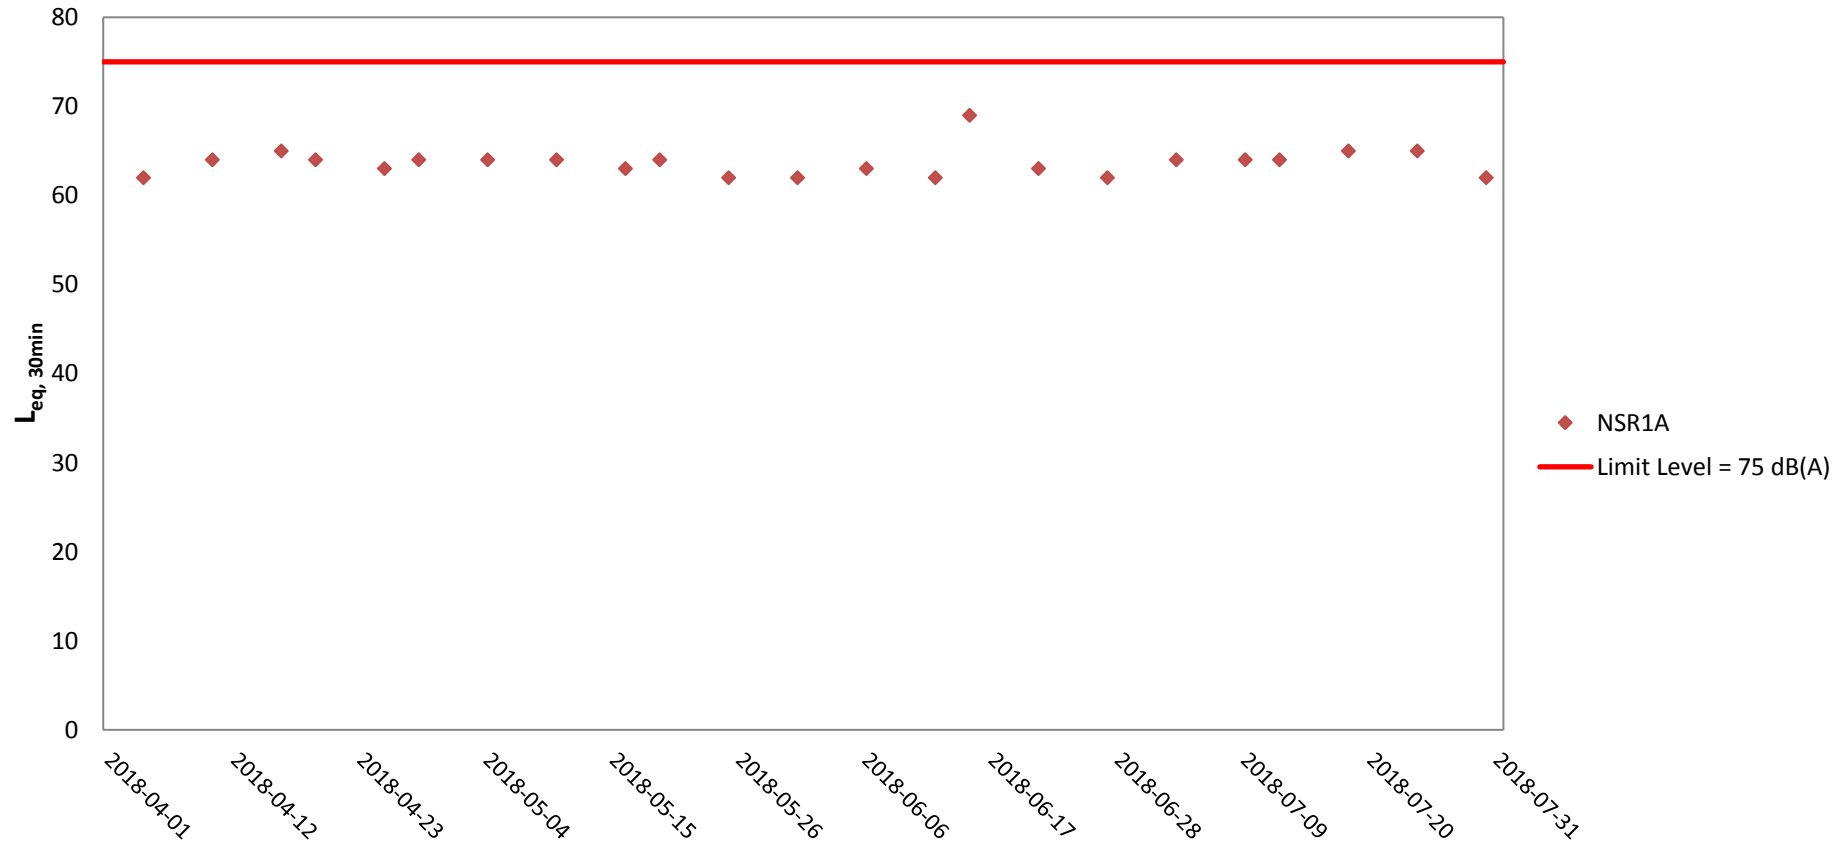

Weather condition within the reporting period varied between sunny to rainy.

Major construction works undertaken within the reporting period include Pier construction; Re-alignment of Cheung Tung Road; Road works along North Lantau Highway; Installation of pier head and deck segments; Asphalt paving; Sign gantries construction; Parapet installation; and Slope work of Viaducts A, B, C & D.

Appendix J

# Impact Water Quality Monitoring Results and Graphical Presentation



Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)5	15:01	13.0	Surface	1	1	29.1	7.9	17.6	5.6	5.5	9.0	9.3	5.6	6.7
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)5	15:01	13.0	Surface	1	2	29.0	7.9	17.7	5.6		8.9		6.7	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)5	15:01	13.0	Middle	2	1	28.6	7.9	18.5	5.3		9.3		9.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)5	15:01	13.0	Middle	2	2	28.5	7.9	18.6	5.3		9.2		7.3	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)5	15:01	13.0	Bottom	3	1	28.1	7.9	21.6	4.7		9.7		6.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)5	15:01	13.0	Bottom	3	2	28.0	7.9	21.8	4.7	4.7	9.6	5.3		
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)3(N)	14:11	7.7	Surface	1	1	29.6	8.0	15.7	5.7	5.5	3.2	7.5	6.6	5.8
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)3(N)	14:11	7.7	Surface	1	2	29.5	8.0	15.6	5.9		3.2		5.2	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)3(N)	14:11	7.7	Middle	2	1	29.4	8.0	17.1	5.1		4.7		5.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)3(N)	14:11	7.7	Middle	2	2	29.3	8.0	17.0	5.3		4.0		6.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)3(N)	14:11	7.7	Bottom	3	1	28.9	8.0	19.8	4.6		4.7		5.5	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	CS(Mf)3(N)	14:11	7.7	Bottom	3	2	28.9	8.0	19.6	4.8	4.7	15.1	6.4		
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)16	14:39	5.9	Surface	1	1	29.4	8.0	18.2	6.1	6.1	6.7	6.4	6.5	5.8
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)16	14:39	5.9	Surface	1	2	29.3	8.0	18.4	6.0		6.6		5.9	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)16	14:39	5.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)16	14:39	5.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)16	14:39	5.9	Bottom	3	1	28.7	7.9	20.7	4.9		5.0		6.2	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)16	14:39	5.9	Bottom	3	2	28.6	7.9	20.6	5.0	5.0	6.1	5.2		
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4a	14:28	5.0	Surface	1	1	29.5	7.9	17.0	6.2	6.2	9.9	10.4	8.5	8.3
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4a	14:28	5.0	Surface	1	2	29.4	8.0	17.2	6.2		9.8		8.6	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4a	14:28	5.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4a	14:28	5.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4a	14:28	5.0	Bottom	3	1	29.1	7.8	18.2	5.0		5.0		10.9	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4a	14:28	5.0	Bottom	3	2	29.0	7.8	18.5	4.9	5.0	10.8	8.3		
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4(N)	14:24	3.5	Surface	1	1	29.8	8.0	16.5	6.6	6.7	10.7	10.4	8.9	9.4
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4(N)	14:24	3.5	Surface	1	2	29.6	8.0	16.7	6.7		10.7		9.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4(N)	14:24	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4(N)	14:24	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4(N)	14:24	3.5	Bottom	3	1	29.8	8.0	16.5	6.7		6.7		10.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	SR4(N)	14:24	3.5	Bottom	3	2	29.6	8.0	16.7	6.7	6.7	10.1	9.6		
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS8	14:18	4.3	Surface	1	1	29.7	8.1	17.4	7.5	7.5	10.7	13.4	7.6	7.0
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS8	14:18	4.3	Surface	1	2	29.6	8.1	17.6	7.4		10.6		6.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS8	14:18	4.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS8	14:18	4.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS8	14:18	4.3	Bottom	3	1	29.6	8.0	18.0	6.4		6.5		16.2	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS8	14:18	4.3	Bottom	3	2	29.5	8.1	18.2	6.5	6.5	16.2	6.4		
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)9	14:12	3.5	Surface	1	1	29.7	8.1	16.6	7.5	7.5	4.5	4.3	5.9	6.6
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)9	14:12	3.5	Surface	1	2	29.6	8.1	16.7	7.5		4.2		6.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)9	14:12	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)9	14:12	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)9	14:12	3.5	Bottom	3	1	29.7	8.1	16.5	7.4		7.5		4.3	
TMCLKL	HY/2012/07	2018-07-02	Mid-Ebb	IS(Mf)9	14:12	3.5	Bottom	3	2	29.6	8.1	16.7	7.5	7.5	4.2	6.2		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)5	7:57	12.8	Surface	1	1	29.4	7.8	15.1	5.6	5.5	5.0	4.5	5.3	4.0
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)5	7:57	12.8	Surface	1	2	29.3	7.9	15.3	5.6		4.7		3.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)5	7:57	12.8	Middle	2	1	28.9	7.9	17.7	5.3		4.6		3.1	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)5	7:57	12.8	Middle	2	2	28.8	7.9	17.9	5.3		4.5		3.8	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)5	7:57	12.8	Bottom	3	1	28.8	7.9	20.1	5.3		4.3		4.5	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)5	7:57	12.8	Bottom	3	2	28.7	7.9	20.3	5.3	5.3	4.1	4.4		
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)3(N)	8:55	7.5	Surface	1	1	29.6	7.9	14.2	5.7	5.6	4.5	5.1	6.2	5.9
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)3(N)	8:55	7.5	Surface	1	2	29.6	8.0	14.0	6.0		4.0		5.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)3(N)	8:55	7.5	Middle	2	1	29.5	7.9	15.8	5.3		4.8		6.7	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)3(N)	8:55	7.5	Middle	2	2	29.4	8.0	15.7	5.5		4.2		6.2	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)3(N)	8:55	7.5	Bottom	3	1	29.4	7.9	17.0	5.1		5.2		6.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	CS(Mf)3(N)	8:55	7.5	Bottom	3	2	29.4	8.0	16.9	5.3	5.2	6.7	5.1		
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)16	8:23	5.7	Surface	1	1	29.3	7.9	17.3	5.9	5.9	5.3	5.5	6.3	5.8
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)16	8:23	5.7	Surface	1	2	29.2	7.9	17.5	5.9		5.2		6.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)16	8:23	5.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)16	8:23	5.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)16	8:23	5.7	Bottom	3	1	29.3	7.9	17.5	5.8		5.9		5.7	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)16	8:23	5.7	Bottom	3	2	29.2	7.9	17.7	5.9	5.9	5.6	5.1		
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4a	8:32	4.8	Surface	1	1	29.5	7.9	16.1	6.2	6.2	5.2	5.0	4.5	4.1
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4a	8:32	4.8	Surface	1	2	29.4	7.9	16.3	6.2		5.0		3.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4a	8:32	4.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4a	8:32	4.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4a	8:32	4.8	Bottom	3	1	29.4	7.9	16.6	6.0		6.1		5.0	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4a	8:32	4.8	Bottom	3	2	29.3	7.9	17.0	6.1	6.1	4.8	4.2		
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4(N)	8:36	3.5	Surface	1	1	29.5	8.0	16.6	6.6	6.6	4.7	4.6	3.9	4.8
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4(N)	8:36	3.5	Surface	1	2	29.4	8.0	16.7	6.6		4.5		4.5	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4(N)	8:36	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4(N)	8:36	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4(N)	8:36	3.5	Bottom	3	1	29.5	8.0	16.6	6.6		6.7		4.8	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	SR4(N)	8:36	3.5	Bottom	3	2	29.4	8.0	16.7	6.7	6.7	4.5	6.0		
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS8	8:45	4.1	Surface	1	1	29.4	8.0	17.0	6.4	6.4	7.8	7.5	4.6	4.9
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS8	8:45	4.1	Surface	1	2	29.3	8.0	17.2	6.4		7.7		3.9	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS8	8:45	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS8	8:45	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS8	8:45	4.1	Bottom	3	1	29.4	8.0	17.3	6.5		6.5		7.2	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS8	8:45	4.1	Bottom	3	2	29.3	8.0	17.5	6.5	6.5	7.1	5.7		
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)9	8:51	3.4	Surface	1	1	29.5	7.9	16.5	6.4	6.4	5.3	5.2	6.2	6.3
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)9	8:51	3.4	Surface	1	2	29.4	8.0	16.7	6.4		5.1		6.8	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)9	8:51	3.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)9	8:51	3.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)9	8:51	3.4	Bottom	3	1	29.5	7.9	16.6	6.4		6.4		5.2	
TMCLKL	HY/2012/07	2018-07-02	Mid-Flood	IS(Mf)9	8:51	3.4	Bottom	3	2	29.4	8.0	16.7	6.4	6.4	5.1	5.3		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	12.3	Surface	1	1	29.0	7.9	17.8	5.9	5.8	7.9	7.2	6.5	6.8
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	12.3	Surface	1	2	28.9	7.9	18.0	5.9		6.7		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	12.3	Middle	2	1	28.8	7.9	18.3	5.7		7.2		7.7	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	12.3	Middle	2	2	28.7	7.9	18.5	5.7		7.6		7.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	12.3	Bottom	3	1	28.5	7.9	19.6	5.4		7.6		6.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	12.3	Bottom	3	2	28.4	7.9	19.9	5.4	5.4	6.1	6.0		
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	7.4	Surface	1	1	29.6	8.0	14.9	6.1	5.9	4.2	3.9	5.6	6.7
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	7.4	Surface	1	2	29.5	8.1	14.8	6.4		4.4		6.2	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	7.4	Middle	2	1	28.7	8.0	16.6	5.5		3.6		7.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	7.4	Middle	2	2	28.6	8.0	16.6	5.7		3.8		6.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	7.4	Bottom	3	1	28.8	7.9	21.4	4.4		4.6		6.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	7.4	Bottom	3	2	28.0	7.9	21.6	4.7	4.6	3.7	7.6		
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	5.8	Surface	1	1	28.9	7.8	18.7	5.4	5.4	8.2	6.6	6.9	7.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	5.8	Surface	1	2	28.8	7.9	18.8	5.4		7.2		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	5.8	Bottom	3	1	28.2	7.8	20.1	5.0		5.0		5.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	5.8	Bottom	3	2	28.1	7.9	20.3	5.0	5.0	5.3	8.3		
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	5.1	Surface	1	1	29.3	7.9	17.9	5.8	5.8	5.5	12.8	6.6	7.3
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	5.1	Surface	1	2	29.2	7.9	18.1	5.8		4.6		6.9	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	5.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	5.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	5.1	Bottom	3	1	28.4	7.7	20.4	3.9		3.9		21.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	5.1	Bottom	3	2	28.2	7.8	20.6	3.9	3.9	20.1	8.1		
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	4.0	Surface	1	1	29.2	7.8	18.0	5.7	5.7	6.6	5.6	7.2	7.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	4.0	Surface	1	2	29.1	7.9	18.2	5.7		5.9		7.7	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	4.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	4.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	4.0	Bottom	3	1	28.7	7.8	18.5	5.5		5.5		5.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	4.0	Bottom	3	2	28.5	7.9	18.6	5.5	5.5	4.6	7.3		
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	4.4	Surface	1	1	29.8	7.9	17.7	6.3	6.3	5.7	9.4	9.4	9.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	4.4	Surface	1	2	29.7	8.0	17.9	6.3		4.9		8.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	4.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	4.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	4.4	Bottom	3	1	28.8	7.8	18.7	5.2		5.3		14.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	4.4	Bottom	3	2	28.6	7.9	18.9	5.3	5.3	13.0	9.9		
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	3.6	Surface	1	1	29.6	7.9	17.8	6.5	6.5	4.0	5.7	4.6	5.0
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	3.6	Surface	1	2	29.5	8.0	18.0	6.5		3.7		5.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	3.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	3.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	3.6	Bottom	3	1	29.7	7.9	18.4	6.4		6.5		7.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	3.6	Bottom	3	2	29.6	8.0	18.6	6.5	6.5	7.6	4.7		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	12.3	Surface	1	1	28.6	7.8	16.4	5.6	5.3	4.6	5.4	6.7	6.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	12.3	Surface	1	2	28.7	7.8	16.3	5.6		5.5		5.9	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	12.3	Middle	2	1	28.2	7.9	19.5	5.0		3.8		7.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	12.3	Middle	2	2	28.3	7.8	19.4	5.0		4.3		6.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	12.3	Bottom	3	1	26.8	7.8	26.4	4.1		7.0		6.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	12.3	Bottom	3	2	26.9	7.8	26.2	4.1	4.1	7.3	6.3		
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	7.0	Surface	1	1	29.0	8.0	14.6	6.0	5.8	4.1	6.7	5.1	5.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	7.0	Surface	1	2	29.1	7.9	14.8	5.8		4.6		4.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	7.0	Middle	2	1	28.7	8.0	15.6	5.7		8.9		5.5	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	7.0	Middle	2	2	28.8	7.9	15.8	5.5		8.0		5.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	7.0	Bottom	3	1	28.9	8.0	17.9	5.3		5.2		7.5	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	7.0	Bottom	3	2	28.9	7.9	18.0	5.0	5.2	7.1	5.5		
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	5.7	Surface	1	1	28.5	7.9	18.0	5.6	5.6	4.4	5.5	6.8	7.2
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	5.7	Surface	1	2	28.7	7.9	17.8	5.6		5.0		7.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	5.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	5.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	5.7	Bottom	3	1	28.4	7.9	18.9	5.2		5.2		5.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	5.7	Bottom	3	2	28.5	7.8	18.8	5.2	5.2	6.6	7.9		
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	5.0	Surface	1	1	28.6	7.9	17.6	5.6	5.6	6.3	12.1	8.0	8.9
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	5.0	Surface	1	2	28.7	7.9	17.4	5.6		6.7		9.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	5.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	5.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	5.0	Bottom	3	1	28.4	7.8	17.9	5.3		5.3		16.2	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	5.0	Bottom	3	2	28.5	7.8	17.7	5.3	5.3	19.0	9.5		
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	3.9	Surface	1	1	28.5	7.9	17.8	5.4	5.4	5.7	5.7	6.1	6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	3.9	Surface	1	2	28.7	7.8	17.6	5.4		6.1		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	3.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	3.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	3.9	Bottom	3	1	28.5	7.9	18.6	5.4		5.4		5.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	3.9	Bottom	3	2	28.6	7.8	18.3	5.4	5.4	5.5	6.8		
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	4.1	Surface	1	1	28.7	7.9	17.1	5.6	5.7	5.3	10.2	5.8	6.3
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	4.1	Surface	1	2	28.8	7.9	16.9	5.7		5.5		5.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	4.1	Bottom	3	1	28.4	7.8	19.7	4.9		4.9		15.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	4.1	Bottom	3	2	28.5	7.8	19.3	4.9	4.9	14.6	7.2		
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	3.3	Surface	1	1	28.8	7.9	17.2	5.8	5.8	5.0	5.6	6.1	6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	3.3	Surface	1	2	28.9	7.9	17.0	5.8		5.4		6.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	3.3	Bottom	3	1	28.7	7.9	17.4	5.7		5.7		5.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	3.3	Bottom	3	2	28.8	7.9	17.2	5.7	5.7	6.2	7.2		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)5	18:04	12.3	Surface	1	1	29.4	8.1	15.2	7.0	6.0	3.7	3.8	5.3	4.1
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)5	18:04	12.3	Surface	1	2	29.6	8.1	15.0	7.0		3.3		3.7	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)5	18:04	12.3	Middle	2	1	27.9	8.0	21.1	4.9		3.0		3.8	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)5	18:04	12.3	Middle	2	2	28.0	8.0	20.9	4.9		4.6		4.1	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)5	18:04	12.3	Bottom	3	1	26.5	7.9	26.1	4.2		5.4		3.5	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)5	18:04	12.3	Bottom	3	2	26.6	7.9	25.7	4.2	4.2	2.8	4.0		
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)3(N)	16:55	7.0	Surface	1	1	29.0	8.2	13.1	6.5	5.7	3.6	5.9	2.8	3.3
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)3(N)	16:55	7.0	Surface	1	2	29.1	8.1	13.2	6.5		3.8		3.8	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)3(N)	16:55	7.0	Middle	2	1	28.3	8.0	18.3	4.9		3.8		2.5	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)3(N)	16:55	7.0	Middle	2	2	28.4	7.9	18.4	4.7		3.8		3.9	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)3(N)	16:55	7.0	Bottom	3	1	27.2	7.9	24.6	4.3		4.2		10.4	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	CS(Mf)3(N)	16:55	7.0	Bottom	3	2	27.3	7.8	24.5	4.0	4.2	10.2	3.4		
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)16	17:42	5.2	Surface	1	1	29.1	8.0	18.0	6.1	6.1	5.6	5.3	2.4	3.7
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)16	17:42	5.2	Surface	1	2	29.2	8.0	17.8	6.1		5.4		2.1	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)16	17:42	5.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)16	17:42	5.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)16	17:42	5.2	Bottom	3	1	28.4	8.0	19.2	5.5		5.5		5.2	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)16	17:42	5.2	Bottom	3	2	28.5	8.0	19.1	5.4	5.5	5.0	4.9		
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4a	17:30	4.6	Surface	1	1	29.6	8.1	17.0	6.6	6.6	4.1	6.0	6.6	7.0
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4a	17:30	4.6	Surface	1	2	29.7	8.1	16.8	6.6		4.7		6.2	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4a	17:30	4.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4a	17:30	4.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4a	17:30	4.6	Bottom	3	1	28.7	8.0	18.3	5.7		5.7		7.5	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4a	17:30	4.6	Bottom	3	2	28.8	8.0	18.3	5.7	5.7	7.5	7.2		
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4(N)	17:26	4.2	Surface	1	1	29.7	8.1	17.1	6.5	6.5	7.7	8.0	4.6	5.3
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4(N)	17:26	4.2	Surface	1	2	29.9	8.1	16.9	6.5		7.5		4.2	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4(N)	17:26	4.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4(N)	17:26	4.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4(N)	17:26	4.2	Bottom	3	1	28.8	7.9	18.5	5.0		5.0		8.2	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	SR4(N)	17:26	4.2	Bottom	3	2	28.9	7.9	18.4	4.9	5.0	8.4	6.6		
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS8	17:19	3.6	Surface	1	1	29.6	8.1	17.4	7.1	7.2	6.0	7.0	4.8	4.3
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS8	17:19	3.6	Surface	1	2	29.8	8.1	17.1	7.2		6.1		5.2	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS8	17:19	3.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS8	17:19	3.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS8	17:19	3.6	Bottom	3	1	29.1	8.0	17.8	6.2		6.2		7.6	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS8	17:19	3.6	Bottom	3	2	29.2	8.0	17.7	6.2	6.2	8.3	3.9		
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)9	17:12	3.3	Surface	1	1	29.2	8.1	17.4	6.8	6.8	4.4	10.4	4.2	3.9
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)9	17:12	3.3	Surface	1	2	29.3	8.1	17.2	6.8		4.6		2.9	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)9	17:12	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)9	17:12	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)9	17:12	3.3	Bottom	3	1	29.1	8.0	17.7	6.0		6.0		16.3	
TMCLKL	HY/2012/07	2018-07-06	Mid-Ebb	IS(Mf)9	17:12	3.3	Bottom	3	2	29.2	8.0	17.6	6.0	6.0	16.1	3.4		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)5	11:43	12.5	Surface	1	1	29.0	8.0	15.4	6.2	5.6	3.0	5.8	3.1	3.3	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)5	11:43	12.5	Surface	1	2	29.1	8.1	15.2	6.2		3.3		2.7		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)5	11:43	12.5	Middle	2	1	27.7	8.0	21.6	5.0		2.3		2.6		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)5	11:43	12.5	Middle	2	2	27.8	8.0	21.4	5.0		2.6		3.1		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)5	11:43	12.5	Bottom	3	1	25.5	7.9	29.8	3.0		11.1		4.1		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)5	11:43	12.5	Bottom	3	2	25.5	8.0	29.5	2.9	3.0	12.3	4.3			
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)3(N)	13:01	7.0	Surface	1	1	29.8	8.1	12.0	6.7	6.1	3.5	8.7	3.8	4.3	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)3(N)	13:01	7.0	Surface	1	2	29.8	8.0	12.1	6.4		4.0		4.6		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)3(N)	13:01	7.0	Middle	2	1	28.7	8.1	14.8	5.6		5.2		3.5		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)3(N)	13:01	7.0	Middle	2	2	28.7	7.9	14.9	5.5		5.1		3.6		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)3(N)	13:01	7.0	Bottom	3	1	28.0	7.9	21.1	4.1		4.0		5.6		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	CS(Mf)3(N)	13:01	7.0	Bottom	3	2	28.0	7.8	21.3	3.9	4.0	16.9	4.8			
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)16	12:12	5.8	Surface	1	1	29.1	8.1	16.2	6.6	6.7	2.7	3.2	3.6	4.3	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)16	12:12	5.8	Surface	1	2	29.2	8.1	16.0	6.7		2.9		4.1		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)16	12:12	5.8	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)16	12:12	5.8	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)16	12:12	5.8	Bottom	3	1	28.9	8.0	16.8	6.4		6.5		3.1		5.1
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)16	12:12	5.8	Bottom	3	2	29.1	8.1	16.4	6.5	6.5	4.1	4.2			
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4a	12:22	4.3	Surface	1	1	29.1	8.0	17.0	5.9	5.9	7.5	11.3	6.6	7.7	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4a	12:22	4.3	Surface	1	2	29.3	8.0	16.8	5.9		8.1		7.0		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4a	12:22	4.3	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4a	12:22	4.3	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4a	12:22	4.3	Bottom	3	1	28.8	7.9	17.9	5.2		5.2		13.9		8.4
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4a	12:22	4.3	Bottom	3	2	28.9	7.9	17.7	5.2	5.2	15.7	8.9			
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4(N)	12:28	4.1	Surface	1	1	29.1	8.0	16.7	6.0	6.0	5.5	6.1	6.8	7.6	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4(N)	12:28	4.1	Surface	1	2	29.2	8.0	16.6	6.0		6.1		7.7		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4(N)	12:28	4.1	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4(N)	12:28	4.1	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4(N)	12:28	4.1	Bottom	3	1	28.9	8.0	17.6	5.6		5.6		6.0		6.7
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	SR4(N)	12:28	4.1	Bottom	3	2	29.1	8.0	17.4	5.6	5.6	6.8	9.3			
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS8	12:35	4.2	Surface	1	1	29.1	8.0	16.5	6.2	6.2	5.0	5.2	4.6	5.1	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS8	12:35	4.2	Surface	1	2	29.3	8.0	16.3	6.2		5.6		4.5		
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS8	12:35	4.2	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS8	12:35	4.2	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS8	12:35	4.2	Bottom	3	1	29.1	8.0	17.5	5.7		5.7		4.9		5.3
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS8	12:35	4.2	Bottom	3	2	29.2	8.0	17.3	5.7	5.7	5.1	5.8			
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)9	12:43	2.9	Surface	1	1					6.0		5.2		3.2	
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)9	12:43	2.9	Surface	1	2										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)9	12:43	2.9	Middle	2	1	29.0	8.0	17.4	6.0		6.0		4.8		2.5
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)9	12:43	2.9	Middle	2	2	29.1	8.0	17.2	6.0		6.0		5.5		3.8
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)9	12:43	2.9	Bottom	3	1										
TMCLKL	HY/2012/07	2018-07-06	Mid-Flood	IS(Mf)9	12:43	2.9	Bottom	3	2										

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)5	9:00	12.3	Surface	1	1	27.5	8.2	22.4	5.4	4.4	3.0	3.7	4.8	5.0
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)5	9:00	12.3	Surface	1	2	27.5	8.1	22.5	5.5		2.2		4.4	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)5	9:00	12.3	Middle	2	1	25.3	8.0	29.6	3.4		4.3		4.5	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)5	9:00	12.3	Middle	2	2	25.3	8.0	29.8	3.4		3.0		3.7	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)5	9:00	12.3	Bottom	3	1	24.8	8.0	30.9	3.0	3.0	4.8	6.2	6.5	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)5	9:00	12.3	Bottom	3	2	24.8	8.0	31.2	2.9		5.0		5.8	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)3(N)	10:07	7.2	Surface	1	1	28.5	8.1	17.4	6.2	4.4	1.8	6.2	3.4	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)3(N)	10:07	7.2	Surface	1	2	28.3	8.0	17.4	6.1		1.5		3.8	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)3(N)	10:07	7.2	Middle	2	1	26.8	7.9	26.0	2.5		8.9		5.6	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)3(N)	10:07	7.2	Middle	2	2	26.7	7.8	26.2	2.6		8.0		5.0	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)3(N)	10:07	7.2	Bottom	3	1	26.7	7.9	26.3	2.5	2.6	9.0	4.9	5.3	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	CS(Mf)3(N)	10:07	7.2	Bottom	3	2	26.6	7.8	26.6	2.6		8.0		6.3	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)16	9:37	5.8	Surface	1	1	28.5	8.4	19.6	7.5	7.6	4.9	4.9	3.8	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)16	9:37	5.8	Surface	1	2	28.5	8.3	19.7	7.6		3.5		4.9	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)16	9:37	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)16	9:37	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)16	9:37	5.8	Bottom	3	1	26.1	8.1	26.9	4.4	4.3	5.5	8.6	5.1	9.5
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)16	9:37	5.8	Bottom	3	2	26.2	8.0	27.2	4.2		5.5		5.9	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4a	9:46	4.9	Surface	1	1	28.5	8.2	19.9	6.1	6.2	4.6	4.5	7.4	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4a	9:46	4.9	Surface	1	2	28.5	8.1	20.1	6.2		3.4		6.4	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4a	9:46	4.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4a	9:46	4.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4a	9:46	4.9	Bottom	3	1	26.6	8.0	26.1	3.6	3.6	13.2	8.6	12.2	9.5
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4a	9:46	4.9	Bottom	3	2	26.6	7.9	26.3	3.5		13.0		11.9	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4(N)	9:52	3.6	Surface	1	1	28.9	8.2	16.8	6.9	6.9	4.7	4.5	5.4	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4(N)	9:52	3.6	Surface	1	2	28.9	8.1	16.9	6.9		4.3		4.5	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4(N)	9:52	3.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4(N)	9:52	3.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4(N)	9:52	3.6	Bottom	3	1	28.7	8.2	18.7	6.4	6.4	4.7	4.5	4.7	4.9
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	SR4(N)	9:52	3.6	Bottom	3	2	28.8	8.2	19.0	6.4		4.4		4.8	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS8	9:59	4.1	Surface	1	1	28.2	8.1	20.8	5.3	5.3	5.0	5.8	7.0	7.2
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS8	9:59	4.1	Surface	1	2	28.2	8.1	20.8	5.3		3.8		6.7	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS8	9:59	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS8	9:59	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS8	9:59	4.1	Bottom	3	1	27.5	8.1	22.8	4.3	4.3	7.2	5.8	7.0	7.2
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS8	9:59	4.1	Bottom	3	2	27.6	8.0	23.0	4.3		7.3		7.9	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)9	10:05	2.8	Surface	1	1					8.3		5.2		5.5
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)9	10:05	2.8	Surface	1	2									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)9	10:05	2.8	Middle	2	1	29.1	8.4	18.2	8.3		5.0		5.4	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)9	10:05	2.8	Middle	2	2	29.1	8.3	18.3	8.2		5.3		5.5	
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)9	10:05	2.8	Bottom	3	1									
TMCLKL	HY/2012/07	2018-07-09	Mid-Ebb	IS(Mf)9	10:05	2.8	Bottom	3	2									





Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)5	11:25	13.7	Surface	1	1	27.7	8.1	22.4	7.2	7.0	12.1	11.0	17.6	18.4
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)5	11:25	13.7	Surface	1	2	27.6	8.0	22.6	7.2		12.2		18.6	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)5	11:25	13.7	Middle	2	1	27.5	8.0	23.1	6.8		9.9		17.9	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)5	11:25	13.7	Middle	2	2	27.4	8.0	23.4	6.8		10.0		18.1	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)5	11:25	13.7	Bottom	3	1	27.2	8.0	24.1	6.4		10.7		19.8	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)5	11:25	13.7	Bottom	3	2	27.1	8.0	24.4	6.4	6.4	10.9	18.3		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)3(N)	12:51	7.0	Surface	1	1	29.9	8.1	14.2	6.8		10.1	5.3	11.6	5.3
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)3(N)	12:51	7.0	Surface	1	2	30.0	8.0	14.3	6.8	10.0	5.3			
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)3(N)	12:51	7.0	Middle	2	1	28.0	8.1	19.7	6.1	11.9	4.6			
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)3(N)	12:51	7.0	Middle	2	2	28.0	8.0	19.9	6.1	11.3	6.3			
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)3(N)	12:51	7.0	Bottom	3	1	27.8	8.1	21.2	6.2	6.2	13.5	4.5		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	CS(Mf)3(N)	12:51	7.0	Bottom	3	2	27.8	8.1	21.4	6.2		13.0	4.9		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)16	12:00	5.8	Surface	1	1	28.5	8.2	23.0	8.7	8.7	6.2	8.5	8.4	7.8
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)16	12:00	5.8	Surface	1	2	28.3	8.2	23.0	8.6		6.3		7.7	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)16	12:00	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)16	12:00	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)16	12:00	5.8	Bottom	3	1	27.3	8.1	24.8	7.0		7.0		10.6	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)16	12:00	5.8	Bottom	3	2	27.1	8.1	25.1	7.0	10.7		7.9		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4a	12:08	5.5	Surface	1	1	28.4	8.2	22.7	8.2	8.2	7.9	8.6	9.0	10.4
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4a	12:08	5.5	Surface	1	2	28.2	8.1	23.0	8.1		8.0		10.6	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4a	12:08	5.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4a	12:08	5.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4a	12:08	5.5	Bottom	3	1	27.7	8.0	23.1	6.8		6.8		9.2	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4a	12:08	5.5	Bottom	3	2	27.5	8.0	23.4	6.8	9.4		11.5		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4(N)	12:15	3.5	Surface	1	1	28.4	8.2	22.3	8.7	8.7	8.5	8.5	7.9	9.2
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4(N)	12:15	3.5	Surface	1	2	28.3	8.1	22.5	8.7		8.6		8.8	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4(N)	12:15	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4(N)	12:15	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4(N)	12:15	3.5	Bottom	3	1	28.5	8.2	22.3	8.7		8.7		8.3	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	SR4(N)	12:15	3.5	Bottom	3	2	28.4	8.1	22.5	8.7	8.4		10.0		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS8	12:21	4.0	Surface	1	1	28.2	8.1	23.0	7.8	7.7	9.7	9.5	9.0	9.4
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS8	12:21	4.0	Surface	1	2	28.0	8.1	23.3	7.6		9.8		8.5	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS8	12:21	4.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS8	12:21	4.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS8	12:21	4.0	Bottom	3	1	28.3	8.0	23.0	7.5		7.6		9.1	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS8	12:21	4.0	Bottom	3	2	28.2	8.0	23.2	7.6	9.2		9.9		
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)9	12:29	3.3	Surface	1	1	28.7	8.2	22.5	9.2	9.2	19.7	18.6	10.3	11.0
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)9	12:29	3.3	Surface	1	2	28.6	8.2	22.7	9.2		19.8		11.4	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)9	12:29	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)9	12:29	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)9	12:29	3.3	Bottom	3	1	28.6	8.2	22.5	9.0		9.0		17.4	
TMCLKL	HY/2012/07	2018-07-11	Mid-Ebb	IS(Mf)9	12:29	3.3	Bottom	3	2	28.5	8.2	22.8	9.0	17.5		10.7		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)5	18:23	13.5	Surface	1	1	27.9	8.2	23.0	8.2	6.7	4.6	6.4	9.2	9.3
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)5	18:23	13.5	Surface	1	2	28.0	8.2	22.7	8.3		4.5		9.5	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)5	18:23	13.5	Middle	2	1	26.4	8.0	26.8	5.1		7.2		8.5	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)5	18:23	13.5	Middle	2	2	26.5	7.9	26.6	5.1		7.1		9.2	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)5	18:23	13.5	Bottom	3	1	26.1	7.9	27.9	5.1		7.6		10.2	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)5	18:23	13.5	Bottom	3	2	26.2	7.9	27.6	5.0	5.1	7.5	9.1		
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)3(N)	17:10	7.0	Surface	1	1	29.7	8.1	14.1	7.6	7.5	12.5	11.7	9.6	10.9
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)3(N)	17:10	7.0	Surface	1	2	29.7	8.1	13.9	7.7		11.7		8.0	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)3(N)	17:10	7.0	Middle	2	1	29.4	8.1	15.9	7.3		12.3		11.2	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)3(N)	17:10	7.0	Middle	2	2	29.4	8.1	15.7	7.4		11.3		10.0	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)3(N)	17:10	7.0	Bottom	3	1	29.0	8.1	17.1	7.2		7.2		13.6	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	CS(Mf)3(N)	17:10	7.0	Bottom	3	2	29.0	8.1	17.1	7.2	7.2	10.8	12.7		
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)16	17:56	5.5	Surface	1	1	28.5	8.3	22.1	10.6	10.6	7.4	10.1	11.5	12.2
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)16	17:56	5.5	Surface	1	2	28.7	8.2	21.9	10.6		7.3		12.2	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)16	17:56	5.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)16	17:56	5.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)16	17:56	5.5	Bottom	3	1	28.4	8.3	22.5	10.0		10.0		12.8	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)16	17:56	5.5	Bottom	3	2	28.5	8.2	22.3	9.9	10.0	12.7	13.0		
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4a	17:46	4.5	Surface	1	1	29.4	8.4	20.2	11.8	11.8	7.4	10.2	7.8	8.8
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4a	17:46	4.5	Surface	1	2	29.5	8.3	20.0	11.8		7.3		9.4	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4a	17:46	4.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4a	17:46	4.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4a	17:46	4.5	Bottom	3	1	29.0	8.4	21.4	11.0		11.0		13.0	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4a	17:46	4.5	Bottom	3	2	29.1	8.3	21.2	11.0	11.0	12.9	9.8		
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4(N)	17:42	3.2	Surface	1	1	29.1	8.4	21.8	11.8	11.8	14.0	14.0	21.8	21.5
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4(N)	17:42	3.2	Surface	1	2	29.2	8.3	21.6	11.8		13.9		21.8	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4(N)	17:42	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4(N)	17:42	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4(N)	17:42	3.2	Bottom	3	1	29.1	8.4	21.8	11.8		11.8		14.2	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	SR4(N)	17:42	3.2	Bottom	3	2	29.2	8.3	21.6	11.8	11.8	14.0	21.4		
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS8	17:36	3.4	Surface	1	1	28.9	8.3	21.6	11.5	11.5	10.7	12.6	9.2	9.2
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS8	17:36	3.4	Surface	1	2	29.0	8.3	21.4	11.5		10.6		9.5	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS8	17:36	3.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS8	17:36	3.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS8	17:36	3.4	Bottom	3	1	28.5	8.3	22.5	10.2		10.2		14.6	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS8	17:36	3.4	Bottom	3	2	28.6	8.2	22.3	10.2	10.2	14.5	9.2		
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)9	17:26	2.9	Surface	1	1					9.8		22.0		7.4
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)9	17:26	2.9	Surface	1	2									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)9	17:26	2.9	Middle	2	1	28.5	8.3	23.1	9.8		22.0		7.5	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)9	17:26	2.9	Middle	2	2	28.6	8.2	22.9	9.8		21.9		7.3	
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)9	17:26	2.9	Bottom	3	1									
TMCLKL	HY/2012/07	2018-07-11	Mid-Flood	IS(Mf)9	17:26	2.9	Bottom	3	2									

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)5	12:23	13.7	Surface	1	1	27.7	8.1	21.8	6.0	5.6	11.8	14.6	8.4	9.5
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)5	12:23	13.7	Surface	1	2	27.7	8.1	22.1	6.0		12.7		8.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)5	12:23	13.7	Middle	2	1	27.3	8.1	23.5	5.3		17.0		8.8	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)5	12:23	13.7	Middle	2	2	27.3	8.0	23.7	5.2		16.6		8.8	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)5	12:23	13.7	Bottom	3	1	26.9	8.0	24.9	5.2	5.2	14.9		11.8	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)5	12:23	13.7	Bottom	3	2	26.9	8.0	25.2	5.1	5.2	14.7	11.3		
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)3(N)	13:44	7.2	Surface	1	1	27.8	7.8	22.2	5.0	5.0	10.5	11.5	10.7	10.6
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)3(N)	13:44	7.2	Surface	1	2	27.7	8.0	22.4	5.0		10.6		10.5	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)3(N)	13:44	7.2	Middle	2	1	27.8	7.8	22.6	4.9		11.0		10.9	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)3(N)	13:44	7.2	Middle	2	2	27.6	8.0	22.8	4.9		11.5		10.9	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)3(N)	13:44	7.2	Bottom	3	1	27.7	7.8	23.0	4.8	4.9	12.6		9.7	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	CS(Mf)3(N)	13:44	7.2	Bottom	3	2	27.5	7.9	23.3	4.9	4.9	13.0	10.7		
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)16	12:57	5.8	Surface	1	1	28.2	8.2	21.0	6.5	6.5	10.3	12.5	10.4	10.2
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)16	12:57	5.8	Surface	1	2	28.2	8.2	21.2	6.5		11.9		10.7	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)16	12:57	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)16	12:57	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)16	12:57	5.8	Bottom	3	1	27.2	8.1	24.2	5.7	5.7	13.4		9.2	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)16	12:57	5.8	Bottom	3	2	27.2	8.1	24.4	5.7	5.7	14.3	10.5		
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4a	13:05	5.1	Surface	1	1	28.3	8.2	20.8	6.2	6.2	16.1	17.9	12.9	12.3
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4a	13:05	5.1	Surface	1	2	28.3	8.1	20.9	6.2		16.4		12.2	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4a	13:05	5.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4a	13:05	5.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4a	13:05	5.1	Bottom	3	1	27.0	8.0	25.0	5.2	5.2	19.8		11.4	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4a	13:05	5.1	Bottom	3	2	27.0	8.0	25.1	5.2	5.2	19.2	12.7		
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4(N)	13:12	4.3	Surface	1	1	28.5	8.2	19.7	7.0	7.0	13.2	13.5	8.1	8.2
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4(N)	13:12	4.3	Surface	1	2	28.5	8.2	19.9	7.0		13.7		7.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4(N)	13:12	4.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4(N)	13:12	4.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4(N)	13:12	4.3	Bottom	3	1	28.5	8.2	19.8	7.1	7.1	13.0		8.4	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	SR4(N)	13:12	4.3	Bottom	3	2	28.5	8.2	19.9	7.0	7.1	13.9	9.2		
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS8	13:18	4.7	Surface	1	1	28.6	8.3	20.6	7.3	7.3	12.4	14.0	13.4	13.5
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS8	13:18	4.7	Surface	1	2	28.6	8.2	20.7	7.3		13.5		13.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS8	13:18	4.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS8	13:18	4.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS8	13:18	4.7	Bottom	3	1	28.4	8.2	21.2	7.0	7.0	14.6		13.3	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS8	13:18	4.7	Bottom	3	2	28.4	8.2	21.4	6.9	7.0	15.4	14.2		
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)9	13:26	3.3	Surface	1	1	28.5	8.2	20.5	7.2	7.2	9.2	10.4	6.1	6.4
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)9	13:26	3.3	Surface	1	2	28.5	8.2	20.6	7.2		10.6		7.2	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)9	13:26	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)9	13:26	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)9	13:26	3.3	Bottom	3	1	28.5	8.2	21.0	6.6	6.6	10.1		6.2	
TMCLKL	HY/2012/07	2018-07-13	Mid-Ebb	IS(Mf)9	13:26	3.3	Bottom	3	2	28.5	8.1	21.1	6.6	6.6	11.5	5.9		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)5	20:24	12.5	Surface	1	1	27.8	8.1	22.2	5.5	5.2	11.1	12.9	5.0	6.3
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)5	20:24	12.5	Surface	1	2	27.8	8.1	22.1	5.6		9.9		5.2	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)5	20:24	12.5	Middle	2	1	27.1	8.0	24.6	4.8		13.1		7.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)5	20:24	12.5	Middle	2	2	27.1	8.0	24.4	4.8		12.5		6.9	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)5	20:24	12.5	Bottom	3	1	26.8	8.0	25.7	4.8	4.8	15.7		6.5	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)5	20:24	12.5	Bottom	3	2	26.8	8.0	25.6	4.8		15.2	6.8		
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)3(N)	19:03	7.0	Surface	1	1	28.7	7.7	16.0	5.3	5.2	10.4	14.4	11.8	12.3
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)3(N)	19:03	7.0	Surface	1	2	28.5	7.8	16.1	5.3		10.4		12.3	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)3(N)	19:03	7.0	Middle	2	1	28.5	7.7	17.1	5.0		15.5		11.8	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)3(N)	19:03	7.0	Middle	2	2	28.4	7.8	17.3	5.0		15.2		11.0	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)3(N)	19:03	7.0	Bottom	3	1	28.4	7.7	17.8	4.9	4.9	17.3		12.6	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	CS(Mf)3(N)	19:03	7.0	Bottom	3	2	28.3	7.8	18.0	4.9		17.3	14.0		
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)16	19:56	5.5	Surface	1	1	28.0	8.1	21.2	6.0	6.1	13.4	13.6	9.2	9.7
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)16	19:56	5.5	Surface	1	2	28.0	8.1	21.1	6.1		12.7		9.5	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)16	19:56	5.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)16	19:56	5.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)16	19:56	5.5	Bottom	3	1	28.0	8.1	21.4	6.1	6.1	14.7		10.4	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)16	19:56	5.5	Bottom	3	2	28.0	8.1	21.3	6.1		13.6	9.6		
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4a	19:44	5.0	Surface	1	1	28.0	8.1	21.0	6.2	6.2	14.8	17.5	12.9	12.9
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4a	19:44	5.0	Surface	1	2	28.0	8.1	20.8	6.2		14.6		13.2	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4a	19:44	5.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4a	19:44	5.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4a	19:44	5.0	Bottom	3	1	28.0	8.1	21.1	6.0	6.1	19.9		12.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4a	19:44	5.0	Bottom	3	2	28.0	8.1	20.9	6.1		20.5	13.2		
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4(N)	19:38	3.5	Surface	1	1	28.0	8.1	21.1	6.3	6.3	16.2	18.2	11.0	12.3
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4(N)	19:38	3.5	Surface	1	2	28.0	8.1	20.9	6.3		15.8		12.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4(N)	19:38	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4(N)	19:38	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4(N)	19:38	3.5	Bottom	3	1	28.0	8.1	21.5	6.2	6.3	20.5		13.9	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	SR4(N)	19:38	3.5	Bottom	3	2	28.0	8.1	21.3	6.3		20.4	12.0		
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS8	19:31	3.2	Surface	1	1	28.0	8.1	21.3	6.3	6.4	18.8	19.5	15.0	14.1
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS8	19:31	3.2	Surface	1	2	28.0	8.1	21.1	6.4		18.3		14.5	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS8	19:31	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS8	19:31	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS8	19:31	3.2	Bottom	3	1	27.9	8.1	21.7	6.3	6.4	20.3		13.7	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS8	19:31	3.2	Bottom	3	2	28.0	8.1	21.5	6.4		20.4	13.1		
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)9	19:21	3.0	Surface	1	1	28.0	8.1	21.3	6.4	6.4	15.1	11.8	10.9	11.7
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)9	19:21	3.0	Surface	1	2	28.0	8.1	21.3	6.4		15.1		11.1	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)9	19:21	3.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)9	19:21	3.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)9	19:21	3.0	Bottom	3	1	28.0	7.8	21.6	6.2	6.2	8.5		11.7	
TMCLKL	HY/2012/07	2018-07-13	Mid-Flood	IS(Mf)9	19:21	3.0	Bottom	3	2	28.0	7.8	21.6	6.2		8.5	13.1		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)5	15:37	12.3	Surface	1	1	27.3	7.9	23.3	5.5	5.1	5.5	11.0	6.1	7.1
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)5	15:37	12.3	Surface	1	2	27.4	7.8	23.1	5.5		5.9		6.6	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)5	15:37	12.3	Middle	2	1	26.8	7.9	24.6	4.7		9.4		7.1	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)5	15:37	12.3	Middle	2	2	27.0	7.8	24.3	4.8		9.0		7.8	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)5	15:37	12.3	Bottom	3	1	26.5	7.9	26.2	4.5		18.0		7.3	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)5	15:37	12.3	Bottom	3	2	26.6	7.8	25.9	4.5	4.5	18.0	7.4		
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)3(N)	14:06	7.1	Surface	1	1	27.7	8.0	21.5	6.0	5.9	9.9	11.6	15.8	10.7
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)3(N)	14:06	7.1	Surface	1	2	27.7	8.0	21.3	6.0		9.6		17.0	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)3(N)	14:06	7.1	Middle	2	1	27.5	8.0	22.2	5.8		11.9		8.3	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)3(N)	14:06	7.1	Middle	2	2	27.5	8.0	22.0	5.8		11.6		8.0	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)3(N)	14:06	7.1	Bottom	3	1	27.3	8.0	24.1	5.8		13.6		8.2	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	CS(Mf)3(N)	14:06	7.1	Bottom	3	2	27.3	8.0	24.0	5.8	5.8	13.2	7.1		
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)16	15:12	5.9	Surface	1	1	27.2	7.9	22.9	5.8	5.8	4.8	12.8	6.3	7.7
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)16	15:12	5.9	Surface	1	2	27.4	7.8	22.6	5.8		5.7		6.9	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)16	15:12	5.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)16	15:12	5.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)16	15:12	5.9	Bottom	3	1	27.1	7.9	23.3	5.6		5.6		20.3	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)16	15:12	5.9	Bottom	3	2	27.2	7.8	23.0	5.6	5.6	20.3	8.3		
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4a	15:01	5.4	Surface	1	1	27.2	7.9	22.7	5.3	5.3	16.4	20.0	5.2	6.3
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4a	15:01	5.4	Surface	1	2	27.3	7.8	22.5	5.3		13.8		6.2	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4a	15:01	5.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4a	15:01	5.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4a	15:01	5.4	Bottom	3	1	27.0	7.9	23.3	5.2		5.1		26.0	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4a	15:01	5.4	Bottom	3	2	27.1	7.7	23.1	4.9	5.1	23.7	6.6		
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4(N)	14:57	4.6	Surface	1	1	27.4	7.9	20.9	5.8	5.8	8.1	11.7	8.1	7.7
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4(N)	14:57	4.6	Surface	1	2	27.5	7.8	20.6	5.8		8.2		7.5	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4(N)	14:57	4.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4(N)	14:57	4.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4(N)	14:57	4.6	Bottom	3	1	27.1	7.9	22.8	5.6		5.6		15.4	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	SR4(N)	14:57	4.6	Bottom	3	2	27.2	7.8	22.6	5.6	5.6	15.2	7.3		
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS8	14:51	4.7	Surface	1	1	27.4	7.9	22.4	5.9	5.9	7.3	8.9	6.0	6.4
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS8	14:51	4.7	Surface	1	2	27.5	7.8	22.2	5.9		6.8		5.6	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS8	14:51	4.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS8	14:51	4.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS8	14:51	4.7	Bottom	3	1	27.2	7.9	22.7	5.9		5.9		11.5	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS8	14:51	4.7	Bottom	3	2	27.3	7.8	22.5	5.8	5.9	10.1	6.7		
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)9	14:41	3.9	Surface	1	1	27.3	7.9	22.8	6.0	6.0	3.9	4.2	5.4	6.5
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)9	14:41	3.9	Surface	1	2	27.5	7.8	22.6	6.0		4.3		6.0	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)9	14:41	3.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)9	14:41	3.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)9	14:41	3.9	Bottom	3	1	27.3	7.9	22.8	6.0		6.0		4.4	
TMCLKL	HY/2012/07	2018-07-16	Mid-Ebb	IS(Mf)9	14:41	3.9	Bottom	3	2	27.4	7.8	22.6	6.0	6.0	4.3	7.7		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)5	8:09	11.3	Surface	1	1	26.9	7.9	22.6	5.4	5.1	5.2	8.9	7.5	7.7
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)5	8:09	11.3	Surface	1	2	27.1	7.8	22.3	5.5		5.8		6.9	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)5	8:09	11.3	Middle	2	1	26.6	7.9	24.8	4.6		9.1		7.6	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)5	8:09	11.3	Middle	2	2	26.7	7.7	24.6	4.8		10.5		7.7	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)5	8:09	11.3	Bottom	3	1	26.5	7.9	26.9	4.6		10.7		8.5	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)5	8:09	11.3	Bottom	3	2	26.7	7.7	26.6	4.5	4.6	11.9	8.1		
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)3(N)	9:18	7.2	Surface	1	1	27.4	8.0	20.2	5.9	5.9	16.7	18.7	19.0	20.1
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)3(N)	9:18	7.2	Surface	1	2	27.4	8.0	20.0	6.0		16.9		20.4	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)3(N)	9:18	7.2	Middle	2	1	27.4	8.0	20.3	5.9		17.5		20.2	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)3(N)	9:18	7.2	Middle	2	2	27.4	8.0	20.1	5.9		17.3		19.3	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)3(N)	9:18	7.2	Bottom	3	1	27.4	8.0	20.5	5.9		5.9		21.8	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	CS(Mf)3(N)	9:18	7.2	Bottom	3	2	27.4	8.0	20.3	5.9	5.9	21.7	20.7		
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)16	8:32	5.7	Surface	1	1	27.0	7.9	22.2	5.5	5.5	5.3	6.3	8.2	8.7
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)16	8:32	5.7	Surface	1	2	27.1	7.8	21.9	5.5		5.9		7.2	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)16	8:32	5.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)16	8:32	5.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)16	8:32	5.7	Bottom	3	1	26.9	7.9	23.2	5.3		5.3		6.6	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)16	8:32	5.7	Bottom	3	2	27.0	7.8	23.0	5.3	5.3	7.2	9.8		
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4a	8:41	4.6	Surface	1	1	27.0	7.9	22.2	5.5	5.5	6.1	6.4	7.7	9.8
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4a	8:41	4.6	Surface	1	2	27.1	7.8	21.9	5.5		6.7		8.5	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4a	8:41	4.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4a	8:41	4.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4a	8:41	4.6	Bottom	3	1	27.0	7.9	22.1	5.6		5.6		6.1	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4a	8:41	4.6	Bottom	3	2	27.2	7.8	21.9	5.5	5.6	6.7	11.9		
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4(N)	8:49	4.1	Surface	1	1	27.0	7.9	22.1	5.5	5.5	5.4	6.0	10.1	10.8
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4(N)	8:49	4.1	Surface	1	2	27.2	7.8	21.8	5.5		5.9		9.9	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4(N)	8:49	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4(N)	8:49	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4(N)	8:49	4.1	Bottom	3	1	27.0	7.9	22.3	5.5		5.5		5.7	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	SR4(N)	8:49	4.1	Bottom	3	2	27.1	7.8	22.1	5.5	5.5	6.8	12.0		
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS8	8:54	4.1	Surface	1	1	27.0	7.9	22.6	5.3	5.3	7.2	8.2	8.2	8.1
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS8	8:54	4.1	Surface	1	2	27.1	7.8	22.4	5.3		8.1		8.1	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS8	8:54	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS8	8:54	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS8	8:54	4.1	Bottom	3	1	26.9	7.9	23.0	5.3		5.3		8.3	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS8	8:54	4.1	Bottom	3	2	27.1	7.8	22.7	5.3	5.3	9.3	8.2		
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)9	9:02	3.3	Surface	1	1	26.9	7.9	22.9	5.5	5.5	7.1	7.7	8.9	9.4
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)9	9:02	3.3	Surface	1	2	27.1	7.8	22.7	5.5		8.1		7.5	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)9	9:02	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)9	9:02	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)9	9:02	3.3	Bottom	3	1	26.9	7.9	23.0	5.5		5.5		7.8	
TMCLKL	HY/2012/07	2018-07-16	Mid-Flood	IS(Mf)9	9:02	3.3	Bottom	3	2	27.1	7.8	22.6	5.5	5.5	7.7	10.8		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)5	16:55	12.3	Surface	1	1	27.6	7.9	24.7	5.7	5.3	4.1	11.7	7.2	8.5	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)5	16:55	12.3	Surface	1	2	27.7	7.8	24.5	5.7		4.4		7.7		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)5	16:55	12.3	Middle	2	1	27.2	7.9	26.2	4.8		14.4		8.6		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)5	16:55	12.3	Middle	2	2	27.3	7.8	25.9	4.8		14.6		9.1		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)5	16:55	12.3	Bottom	3	1	27.0	7.9	27.7	4.7		16.3		8.9		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)5	16:55	12.3	Bottom	3	2	27.1	7.8	27.4	4.7	4.7	16.6	9.4			
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)3(N)	15:57	7.2	Surface	1	1	28.3	8.0	20.7	6.3	6.1	8.0	9.8	3.5	3.6	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)3(N)	15:57	7.2	Surface	1	2	28.3	8.0	20.9	6.2		8.0		2.8		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)3(N)	15:57	7.2	Middle	2	1	28.0	8.0	21.8	5.9		8.4		3.3		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)3(N)	15:57	7.2	Middle	2	2	28.0	8.0	22.0	5.8		10.1		4.1		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)3(N)	15:57	7.2	Bottom	3	1	27.7	8.0	24.4	5.6		5.6		11.6		3.8
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	CS(Mf)3(N)	15:57	7.2	Bottom	3	2	27.7	8.0	24.7	5.5	5.6	12.9	4.2			
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)16	16:28	5.7	Surface	1	1	27.8	7.9	23.8	6.1	6.1	4.0	5.2	7.1	7.3	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)16	16:28	5.7	Surface	1	2	27.9	7.8	23.6	6.1		4.6		6.7		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)16	16:28	5.7	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)16	16:28	5.7	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)16	16:28	5.7	Bottom	3	1	27.3	7.9	25.3	5.2		5.2		6.5		8.0
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)16	16:28	5.7	Bottom	3	2	27.4	7.8	25.0	5.2	5.2	5.7	7.5			
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4a	16:17	4.6	Surface	1	1	27.8	8.0	24.0	6.0	6.0	3.1	3.3	6.0	6.2	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4a	16:17	4.6	Surface	1	2	27.9	7.8	23.8	6.0		4.0		5.8		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4a	16:17	4.6	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4a	16:17	4.6	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4a	16:17	4.6	Bottom	3	1	27.7	8.0	24.3	6.0		6.0		2.9		6.2
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4a	16:17	4.6	Bottom	3	2	27.8	7.8	24.0	6.0	6.0	3.3	6.8			
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4(N)	16:12	4.3	Surface	1	1	27.6	7.9	23.9	5.7	5.7	3.9	3.8	6.0	6.5	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4(N)	16:12	4.3	Surface	1	2	27.7	7.8	23.7	5.7		4.3		6.7		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4(N)	16:12	4.3	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4(N)	16:12	4.3	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4(N)	16:12	4.3	Bottom	3	1	27.5	7.9	24.4	5.7		5.7		3.5		6.8
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	SR4(N)	16:12	4.3	Bottom	3	2	27.6	7.8	24.2	5.7	5.7	3.6	6.6			
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS8	16:05	4.2	Surface	1	1	27.8	8.0	23.5	6.4	6.4	3.3	3.6	4.4	4.8	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS8	16:05	4.2	Surface	1	2	28.0	7.8	23.3	6.4		3.6		3.8		
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS8	16:05	4.2	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS8	16:05	4.2	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS8	16:05	4.2	Bottom	3	1	27.7	8.0	23.6	6.4		6.4		3.9		6.0
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS8	16:05	4.2	Bottom	3	2	27.9	7.8	23.3	6.4	6.4	3.5	5.1			
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)9	15:57	3.6	Surface	1	1	27.8	8.0	23.5	6.5	6.5	2.1	2.4	4.5	5.3	
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)9	15:57	3.6	Surface	1	2	27.9	7.8	23.3	6.5		6.5		2.5		5.0
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)9	15:57	3.6	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)9	15:57	3.6	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)9	15:57	3.6	Bottom	3	1	27.8	8.0	23.5	6.5		6.5		2.6		5.6
TMCLKL	HY/2012/07	2018-07-18	Mid-Ebb	IS(Mf)9	15:57	3.6	Bottom	3	2	28.0	7.8	23.2	6.5	6.5	2.4	6.1			

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)5	18:57	12.9	Surface	1	1	28.2	8.0	25.0	6.9	6.1	0.9	2.1	4.5	4.9
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)5	18:57	12.9	Surface	1	2	28.1	8.0	25.3	6.8		0.8		4.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)5	18:57	12.9	Middle	2	1	27.5	7.9	27.6	5.3		1.0		4.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)5	18:57	12.9	Middle	2	2	27.4	7.9	27.9	5.3		1.0		5.1	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)5	18:57	12.9	Bottom	3	1	27.5	7.9	28.7	5.2		4.5		4.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)5	18:57	12.9	Bottom	3	2	27.3	7.9	29.0	5.2	5.2	4.4	5.5		
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)3(N)	17:46	7.0	Surface	1	1	29.0	8.1	22.3	6.7	6.1	4.1	7.4	2.6	3.9
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)3(N)	17:46	7.0	Surface	1	2	29.0	8.1	22.1	6.8		4.8		2.4	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)3(N)	17:46	7.0	Middle	2	1	27.9	8.0	24.1	5.4		7.5		3.7	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)3(N)	17:46	7.0	Middle	2	2	27.9	8.0	23.8	5.5		7.6		4.2	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)3(N)	17:46	7.0	Bottom	3	1	27.9	8.0	25.1	5.5		10.5		5.4	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	CS(Mf)3(N)	17:46	7.0	Bottom	3	2	27.9	8.0	24.9	5.6	5.6	10.1	5.1		
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)16	18:30	5.8	Surface	1	1	28.4	8.0	24.5	6.8	6.8	3.9	3.2	5.2	6.5
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)16	18:30	5.8	Surface	1	2	28.3	8.0	24.8	6.8		3.5		5.5	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)16	18:30	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)16	18:30	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)16	18:30	5.8	Bottom	3	1	27.5	7.9	26.7	5.4		5.4		2.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)16	18:30	5.8	Bottom	3	2	27.4	7.9	26.9	5.4	5.4	2.4	8.1		
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4a	18:20	4.4	Surface	1	1	28.4	7.9	24.4	6.6	6.6	3.7	6.3	4.7	5.7
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4a	18:20	4.4	Surface	1	2	28.2	7.9	24.6	6.6		3.3		4.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4a	18:20	4.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4a	18:20	4.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4a	18:20	4.4	Bottom	3	1	28.1	7.9	24.6	5.9		5.9		8.7	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4a	18:20	4.4	Bottom	3	2	27.9	7.9	24.9	5.9	5.9	9.3	7.2		
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4(N)	18:15	4.1	Surface	1	1	28.5	7.9	23.6	5.9	5.9	5.3	5.7	5.4	6.6
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4(N)	18:15	4.1	Surface	1	2	28.4	7.9	24.0	5.9		5.1		6.7	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4(N)	18:15	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4(N)	18:15	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4(N)	18:15	4.1	Bottom	3	1	28.2	7.8	24.4	5.4		5.4		6.3	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	SR4(N)	18:15	4.1	Bottom	3	2	28.1	7.9	24.7	5.4	5.4	6.2	6.9		
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS8	18:08	3.6	Surface	1	1	28.6	8.0	24.3	7.4	7.4	6.2	4.5	6.2	6.2
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS8	18:08	3.6	Surface	1	2	28.5	8.0	24.5	7.4		6.2		5.7	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS8	18:08	3.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS8	18:08	3.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS8	18:08	3.6	Bottom	3	1	28.6	8.0	24.4	7.4		7.4		2.9	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS8	18:08	3.6	Bottom	3	2	28.4	8.0	24.7	7.4	7.4	2.6	6.5		
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)9	17:59	3.3	Surface	1	1	28.6	8.0	24.5	7.5	7.5	3.9	4.0	4.1	4.4
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)9	17:59	3.3	Surface	1	2	28.5	8.0	24.7	7.5		3.5		4.4	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)9	17:59	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)9	17:59	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)9	17:59	3.3	Bottom	3	1	28.6	8.0	24.6	7.4		7.4		4.1	
TMCLKL	HY/2012/07	2018-07-20	Mid-Ebb	IS(Mf)9	17:59	3.3	Bottom	3	2	28.5	8.0	24.8	7.4	7.4	4.3	4.2		



Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)5	12:26	13.3	Surface	1	1	28.0	8.0	24.3	6.2	5.7	1.0	5.9	2.2	3.3
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)5	12:26	13.3	Surface	1	2	28.2	7.9	24.1	6.2		1.2		2.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)5	12:26	13.3	Middle	2	1	27.3	7.9	27.0	5.2		2.2		3.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)5	12:26	13.3	Middle	2	2	27.5	7.8	26.7	5.2		2.5		2.8	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)5	12:26	13.3	Bottom	3	1	27.3	7.9	28.6	5.1		13.9		4.3	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)5	12:26	13.3	Bottom	3	2	27.4	7.8	28.4	5.1	5.1	14.3	3.8		
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)3(N)	13:56	7.0	Surface	1	1	28.8	8.0	21.9	6.3	6.2	8.3	9.3	3.9	4.9
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)3(N)	13:56	7.0	Surface	1	2	28.8	8.0	22.1	6.2		8.3		3.0	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)3(N)	13:56	7.0	Middle	2	1	28.5	8.0	22.3	6.1		9.1		5.3	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)3(N)	13:56	7.0	Middle	2	2	28.5	8.0	22.5	6.0		8.9		5.7	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)3(N)	13:56	7.0	Bottom	3	1	28.3	8.1	22.8	6.0		6.0		5.2	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	CS(Mf)3(N)	13:56	7.0	Bottom	3	2	28.3	8.0	23.0	6.0	6.0	10.9	6.1		
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)16	12:55	5.8	Surface	1	1	28.2	8.0	24.5	6.4	6.4	1.3	1.7	1.6	2.6
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)16	12:55	5.8	Surface	1	2	28.3	7.9	24.2	6.4		1.5		1.5	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)16	12:55	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)16	12:55	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)16	12:55	5.8	Bottom	3	1	28.0	8.0	24.6	6.4		6.4		1.9	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)16	12:55	5.8	Bottom	3	2	28.1	7.9	24.4	6.4	6.4	1.9	3.2		
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4a	13:05	3.5	Surface	1	1	28.0	7.9	24.9	5.8	5.9	3.0	5.3	6.6	6.2
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4a	13:05	3.5	Surface	1	2	28.1	7.9	24.6	5.9		3.3		5.5	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4a	13:05	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4a	13:05	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4a	13:05	3.5	Bottom	3	1	27.7	7.9	25.3	5.7		5.7		7.3	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4a	13:05	3.5	Bottom	3	2	27.8	7.9	25.0	5.7	5.7	7.5	5.9		
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4(N)	13:11	3.2	Surface	1	1	28.2	7.9	24.7	6.1	6.1	3.5	3.7	4.9	5.6
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4(N)	13:11	3.2	Surface	1	2	28.3	7.9	24.5	6.0		4.0		5.0	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4(N)	13:11	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4(N)	13:11	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4(N)	13:11	3.2	Bottom	3	1	28.2	7.9	24.8	6.0		6.0		3.4	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	SR4(N)	13:11	3.2	Bottom	3	2	28.3	7.9	24.5	6.0	6.0	3.9	5.9		
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS8	13:19	3.6	Surface	1	1	28.1	8.0	24.5	6.3	6.3	2.9	2.4	3.5	4.2
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS8	13:19	3.6	Surface	1	2	28.2	7.9	24.3	6.3		2.9		4.4	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS8	13:19	3.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS8	13:19	3.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS8	13:19	3.6	Bottom	3	1	28.0	7.9	24.8	6.2		6.2		1.9	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS8	13:19	3.6	Bottom	3	2	28.2	7.9	24.5	6.2	6.2	2.0	4.9		
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)9	13:30	3.5	Surface	1	1	28.3	8.0	24.6	6.5	6.5	1.3	3.4	2.9	2.9
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)9	13:30	3.5	Surface	1	2	28.5	7.9	24.3	6.5		1.5		2.1	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)9	13:30	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)9	13:30	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)9	13:30	3.5	Bottom	3	1	27.9	7.9	24.9	6.2		6.2		5.5	
TMCLKL	HY/2012/07	2018-07-20	Mid-Flood	IS(Mf)9	13:30	3.5	Bottom	3	2	28.0	7.9	24.7	6.2	6.2	5.3	3.1		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)5	9:47	12.0	Surface	1	1	28.8	8.2	21.8	9.2	7.5	3.9	5.2	8.2	9.7
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)5	9:47	12.0	Surface	1	2	29.0	8.2	21.6	9.3		4.1		9.1	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)5	9:47	12.0	Middle	2	1	28.1	8.0	26.8	5.7		4.9		9.8	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)5	9:47	12.0	Middle	2	2	28.3	7.9	26.5	5.7		5.3		9.1	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)5	9:47	12.0	Bottom	3	1	27.9	8.0	29.3	5.3		6.3		10.5	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)5	9:47	12.0	Bottom	3	2	28.1	7.9	29.0	5.3	5.3	6.8	11.4		
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)3(N)	11:05	7.2	Surface	1	1	29.2	8.3	19.7	7.8	7.0	7.9	11.2	10.1	10.1
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)3(N)	11:05	7.2	Surface	1	2	29.1	8.3	19.8	7.8		8.7		9.2	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)3(N)	11:05	7.2	Middle	2	1	28.8	8.2	22.1	6.3		10.6		10.9	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)3(N)	11:05	7.2	Middle	2	2	28.7	8.1	22.5	6.2		11.2		9.7	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)3(N)	11:05	7.2	Bottom	3	1	28.3	8.1	25.7	5.8		5.8		10.1	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	CS(Mf)3(N)	11:05	7.2	Bottom	3	2	28.3	8.1	25.9	5.8	5.8	14.5	10.3		
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)16	10:15	5.8	Surface	1	1	29.5	8.5	20.1	11.9	12.0	4.2	7.5	12.7	12.6
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)16	10:15	5.8	Surface	1	2	29.6	8.5	19.9	12.1		4.0		12.2	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)16	10:15	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)16	10:15	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)16	10:15	5.8	Bottom	3	1	28.6	8.1	24.5	7.5		7.5		10.4	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)16	10:15	5.8	Bottom	3	2	28.7	8.1	24.4	7.5	7.5	11.4	12.6		
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4a	10:26	5.9	Surface	1	1	29.3	8.2	22.4	9.5	9.5	10.1	14.6	8.6	8.8
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4a	10:26	5.9	Surface	1	2	29.4	8.2	22.0	9.5		10.9		7.6	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4a	10:26	5.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4a	10:26	5.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4a	10:26	5.9	Bottom	3	1	28.3	7.9	25.4	5.6		5.6		18.5	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4a	10:26	5.9	Bottom	3	2	28.4	7.9	25.1	5.6	5.6	19.0	9.7		
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4(N)	10:34	3.2	Surface	1	1	29.5	8.3	19.6	10.8	10.9	5.9	6.5	9.1	10.7
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4(N)	10:34	3.2	Surface	1	2	29.7	8.3	19.3	10.9		6.4		8.2	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4(N)	10:34	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4(N)	10:34	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4(N)	10:34	3.2	Bottom	3	1	29.5	8.3	19.8	10.7		10.7		6.5	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	SR4(N)	10:34	3.2	Bottom	3	2	29.7	8.3	19.7	10.7	10.7	7.2	13.2		
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS8	10:42	3.5	Surface	1	1	29.7	8.5	19.7	13.2	13.2	4.1	5.6	7.1	7.4
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS8	10:42	3.5	Surface	1	2	29.9	8.5	19.5	13.1		4.1		6.8	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS8	10:42	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS8	10:42	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS8	10:42	3.5	Bottom	3	1	29.7	8.5	19.7	12.5		12.5		7.1	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS8	10:42	3.5	Bottom	3	2	29.6	8.5	20.0	12.4	12.5	7.2	8.0		
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)9	10:50	3.1	Surface	1	1	29.4	8.5	19.0	12.3	12.3	4.2	4.4	10.3	10.9
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)9	10:50	3.1	Surface	1	2	29.5	8.5	18.8	12.3		4.5		10.8	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)9	10:50	3.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)9	10:50	3.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)9	10:50	3.1	Bottom	3	1	29.4	8.5	19.1	12.3		12.3		4.2	
TMCLKL	HY/2012/07	2018-07-23	Mid-Ebb	IS(Mf)9	10:50	3.1	Bottom	3	2	29.5	8.5	18.8	12.3	12.3	4.5	11.5		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)5	17:20	12.5	Surface	1	1	28.5	8.0	25.8	6.6	6.2	4.0	8.1	7.6	8.4
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)5	17:20	12.5	Surface	1	2	28.3	8.1	26.0	6.6		3.6		7.0	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)5	17:20	12.5	Middle	2	1	28.3	8.0	27.0	5.8		5.4		8.0	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)5	17:20	12.5	Middle	2	2	28.2	8.0	27.3	5.8		4.7		8.6	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)5	17:20	12.5	Bottom	3	1	28.2	8.0	28.9	5.5		15.9		9.8	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)5	17:20	12.5	Bottom	3	2	28.0	8.0	29.2	5.5	5.5	14.9	9.3		
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)3(N)	16:03	7.1	Surface	1	1	29.1	8.3	18.3	7.9	7.1	8.7	11.8	8.0	9.1
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)3(N)	16:03	7.1	Surface	1	2	29.1	8.3	18.6	7.9		9.6		8.3	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)3(N)	16:03	7.1	Middle	2	1	28.8	8.1	21.0	6.2		11.6		9.0	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)3(N)	16:03	7.1	Middle	2	2	28.8	8.1	21.4	6.2		11.2		9.4	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)3(N)	16:03	7.1	Bottom	3	1	28.6	8.1	22.9	6.1		6.1		14.6	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	CS(Mf)3(N)	16:03	7.1	Bottom	3	2	28.6	8.0	23.2	6.1	6.1	15.0	10.0		
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)16	16:52	5.6	Surface	1	1	29.5	8.4	20.9	11.0	11.0	5.4	9.7	8.4	8.7
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)16	16:52	5.6	Surface	1	2	29.3	8.4	21.1	10.9		5.1		7.6	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)16	16:52	5.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)16	16:52	5.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)16	16:52	5.6	Bottom	3	1	28.6	8.0	25.0	6.3		6.3		15.1	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)16	16:52	5.6	Bottom	3	2	28.4	8.2	23.6	6.3	6.3	13.2	9.3		
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4a	16:42	4.3	Surface	1	1	28.9	8.1	23.0	7.9	7.9	11.1	13.6	13.4	13.7
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4a	16:42	4.3	Surface	1	2	28.8	8.1	23.2	7.9		9.3		12.5	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4a	16:42	4.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4a	16:42	4.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4a	16:42	4.3	Bottom	3	1	28.5	7.9	24.6	6.1		6.1		18.1	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4a	16:42	4.3	Bottom	3	2	28.4	8.0	24.8	6.1	6.1	16.0	14.0		
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4(N)	16:37	3.2	Surface	1	1	29.4	8.2	22.3	9.4	9.4	13.1	12.7	16.5	16.6
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4(N)	16:37	3.2	Surface	1	2	29.2	8.2	22.6	9.3		11.4		16.3	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4(N)	16:37	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4(N)	16:37	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4(N)	16:37	3.2	Bottom	3	1	29.1	8.1	23.2	8.1		8.1		13.5	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	SR4(N)	16:37	3.2	Bottom	3	2	28.9	8.1	23.4	8.0	8.1	12.6	16.2		
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS8	16:29	3.3	Surface	1	1	29.5	8.4	21.2	11.3	11.3	8.8	12.6	11.9	11.9
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS8	16:29	3.3	Surface	1	2	29.4	8.4	21.4	11.2		8.4		11.0	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS8	16:29	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS8	16:29	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS8	16:29	3.3	Bottom	3	1	29.2	8.2	22.7	8.5		8.5		17.2	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS8	16:29	3.3	Bottom	3	2	29.1	8.2	23.1	8.5	8.5	15.8	11.7		
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)9	16:21	3.3	Surface	1	1	30.0	8.6	20.2	12.5	12.5	7.0	9.1	9.8	10.6
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)9	16:21	3.3	Surface	1	2	29.8	8.5	20.3	12.5		6.5		10.8	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)9	16:21	3.3	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)9	16:21	3.3	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)9	16:21	3.3	Bottom	3	1	29.8	8.5	20.9	11.7		11.7		11.8	
TMCLKL	HY/2012/07	2018-07-23	Mid-Flood	IS(Mf)9	16:21	3.3	Bottom	3	2	29.7	8.5	21.1	11.6	11.7	10.9	11.1		

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	12.3	Surface	1	1	29.3	8.1	19.9	7.1	6.7	4.3	7.3	7.8	8.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	12.3	Surface	1	2	29.2	8.0	20.1	7.1		4.1		8.2		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	12.3	Middle	2	1	28.8	8.0	23.3	6.3		7.7		9.0		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	12.3	Middle	2	2	28.6	8.0	23.4	6.3		7.2		8.9		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	12.3	Bottom	3	1	28.5	8.0	27.0	5.4		10.5		9.5		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	12.3	Bottom	3	2	28.4	8.0	27.2	5.4	5.4	10.1	9.0			
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	7.0	Surface	1	1	29.7	8.2	17.0	7.6	7.4	7.7	10.7	5.5	5.5	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	7.0	Surface	1	2	29.7	8.2	17.2	7.5		8.8		5.2		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	7.0	Middle	2	1	29.3	8.2	17.5	7.3		9.5		5.4		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	7.0	Middle	2	2	29.3	8.2	17.8	7.1		10.5		5.6		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	7.0	Bottom	3	1	28.9	8.1	21.2	6.2		6.2		5.7		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	7.0	Bottom	3	2	28.9	8.1	21.5	6.1	6.2	13.9	5.7			
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	5.6	Surface	1	1	29.1	8.1	22.2	7.2	7.2	6.5	6.6	8.7	10.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	5.6	Surface	1	2	28.9	8.1	22.4	7.2		5.9		9.7		
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	5.6	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	5.6	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	5.6	Bottom	3	1	28.7	8.0	23.7	6.5		6.6		7.4		11.1
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	5.6	Bottom	3	2	28.6	8.1	23.9	6.6	6.6	6.5	11.6			
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	4.3	Surface	1	1	29.1	8.1	22.0	6.6	6.6	9.3	12.0	9.1	11.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	4.3	Surface	1	2	29.0	8.1	22.2	6.5		6.6		9.0		9.6
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	4.3	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	4.3	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	4.3	Bottom	3	1	28.9	7.9	22.6	5.4		5.4		14.9		13.8
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	4.3	Bottom	3	2	28.7	7.9	22.8	5.3	5.4	14.8	12.8			
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	3.7	Surface	1	1	29.1	8.1	21.9	7.0	7.0	8.6	12.6	7.2	7.5	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	3.7	Surface	1	2	28.9	8.1	22.2	6.9		7.0		8.1		6.4
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	3.7	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	3.7	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	3.7	Bottom	3	1	29.0	8.0	22.5	6.0		6.1		17.0		8.4
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	3.7	Bottom	3	2	28.8	8.0	22.7	6.1	6.1	16.8	8.1			
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	3.6	Surface	1	1	29.5	8.2	21.3	8.2	8.2	4.0	6.1	7.0	7.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	3.6	Surface	1	2	29.4	8.2	21.5	8.2		8.2		3.8		7.2
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	3.6	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	3.6	Middle	2	2										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	3.6	Bottom	3	1	29.0	8.1	22.3	6.9		7.0		8.3		8.1
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	3.6	Bottom	3	2	28.8	8.1	22.5	7.0	7.0	8.2	7.4			
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	2.8	Surface	1	1					7.5		5.3		7.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	2.8	Surface	1	2										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	2.8	Middle	2	1	29.2	8.2	21.7	7.5		7.5		5.2		7.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	2.8	Middle	2	2	29.0	8.1	21.9	7.5				5.3		6.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	2.8	Bottom	3	1										
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	2.8	Bottom	3	2										

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	12.2	Surface	1	1	29.3	8.1	20.9	8.5	7.6	5.0	8.5	5.4	6.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	12.2	Surface	1	2	29.4	8.2	20.7	8.5		5.7		6.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	12.2	Middle	2	1	28.9	8.0	22.2	6.7		5.8		6.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	12.2	Middle	2	2	29.0	8.1	21.9	6.7		6.2		5.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	12.2	Bottom	3	1	28.5	8.0	24.8	5.8	5.8	14.1		7.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	12.2	Bottom	3	2	28.7	8.0	24.6	5.8		14.3	7.3		
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	7.0	Surface	1	1	30.2	8.1	12.2	6.7	6.6	10.1	10.1	3.9	5.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	7.0	Surface	1	2	30.2	8.1	12.0	6.9		9.0		4.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	7.0	Middle	2	1	30.0	8.0	15.6	6.3		11.5		5.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	7.0	Middle	2	2	30.0	8.0	15.5	6.4		10.3		4.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	7.0	Bottom	3	1	29.7	8.0	16.9	6.2	6.3	10.3		6.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	7.0	Bottom	3	2	29.7	8.0	16.6	6.4		9.6	7.7		
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	5.4	Surface	1	1	29.3	8.1	20.8	8.6	8.6	10.9	13.7	16.1	16.0
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	5.4	Surface	1	2	29.5	8.2	20.6	8.6		10.3		15.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	5.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	5.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	5.4	Bottom	3	1	29.4	8.1	21.0	8.6	8.6	16.9		16.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	5.4	Bottom	3	2	29.5	8.2	20.8	8.6		16.8	16.1		
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	4.1	Surface	1	1	29.6	8.1	20.1	9.1	9.2	13.1	16.6	35.3	35.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	4.1	Surface	1	2	29.7	8.2	19.9	9.2		13.9		34.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	4.1	Bottom	3	1	29.4	8.1	20.3	8.5	8.5	19.8		37.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	4.1	Bottom	3	2	29.5	8.2	20.1	8.5		19.7	35.6		
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	3.4	Surface	1	1	29.5	8.1	20.4	8.9	8.9	10.8	14.4	13.9	14.9
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	3.4	Surface	1	2	29.6	8.2	20.2	8.9		11.0		15.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	3.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	3.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	3.4	Bottom	3	1	29.4	8.1	21.4	8.1	8.1	18.0		14.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	3.4	Bottom	3	2	29.5	8.2	21.1	8.1		17.7	15.6		
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	3.2	Surface	1	1	29.5	8.1	20.5	8.9	8.9	14.4	16.9	16.6	17.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	3.2	Surface	1	2	29.6	8.2	20.3	8.9		15.8		17.5	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	3.2	Bottom	3	1	29.1	8.0	22.4	6.7	6.7	18.8		18.1	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	3.2	Bottom	3	2	29.2	8.0	22.1	6.7		18.5	18.5		
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	2.7	Surface	1	1					8.7		17.5		19.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	2.7	Surface	1	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	2.7	Middle	2	1	29.5	8.1	21.2	8.7		17.5		19.8	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	2.7	Middle	2	2	29.7	8.2	21.0	8.7		17.4		18.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	2.7	Bottom	3	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	2.7	Bottom	3	2									



Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)5	12:03	12.0	Surface	1	1	29.8	8.0	21.6	6.6	6.0	3.3	4.8	7.2	8.5
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)5	12:03	12.0	Surface	1	2	30.0	8.0	21.3	6.6		3.4		8.1	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)5	12:03	12.0	Middle	2	1	29.0	8.0	24.4	5.4		4.2		8.1	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)5	12:03	12.0	Middle	2	2	29.1	8.0	24.2	5.4		4.3		8.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)5	12:03	12.0	Bottom	3	1	28.9	8.0	28.4	5.0	5.0	6.6	6.0	9.1	3.4
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)5	12:03	12.0	Bottom	3	2	29.0	8.0	28.1	5.0		6.7		10.2	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)3(N)	13:33	7.1	Surface	1	1	29.5	7.8	20.6	6.0	5.7	2.2	6.0	2.1	11.0
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)3(N)	13:33	7.1	Surface	1	2	29.5	7.9	20.3	5.9		2.1		3.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)3(N)	13:33	7.1	Middle	2	1	29.3	7.8	21.8	5.5		7.2		3.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)3(N)	13:33	7.1	Middle	2	2	29.3	7.9	21.6	5.3		7.7		3.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)3(N)	13:33	7.1	Bottom	3	1	29.2	7.8	22.6	5.4	5.4	8.0	7.9	3.9	11.1
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	CS(Mf)3(N)	13:33	7.1	Bottom	3	2	29.2	7.9	22.4	5.3		8.6		4.2	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)16	12:34	5.8	Surface	1	1	29.5	8.2	21.6	6.7	6.8	7.6	20.9	10.1	12.7
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)16	12:34	5.8	Surface	1	2	29.7	8.1	21.4	6.8		7.7		10.8	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)16	12:34	5.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)16	12:34	5.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)16	12:34	5.8	Bottom	3	1	29.1	8.1	24.4	5.9	5.9	8.1	7.5	11.3	12.7
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)16	12:34	5.8	Bottom	3	2	29.2	8.0	24.0	5.9		8.2		11.8	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4a	12:43	4.8	Surface	1	1	29.3	8.1	21.4	6.0	6.0	20.4	13.7	10.4	7.5
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4a	12:43	4.8	Surface	1	2	29.5	8.0	21.2	6.0		20.5		11.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4a	12:43	4.8	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4a	12:43	4.8	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4a	12:43	4.8	Bottom	3	1	29.2	8.1	23.0	5.3	5.4	21.2	11.8	11.2	12.7
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4a	12:43	4.8	Bottom	3	2	29.3	8.0	22.8	5.5		21.3		11.5	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4(N)	12:49	3.5	Surface	1	1	29.7	8.2	21.0	7.5	7.5	11.4	13.7	12.1	12.7
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4(N)	12:49	3.5	Surface	1	2	29.9	8.2	20.8	7.5		11.5		11.5	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4(N)	12:49	3.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4(N)	12:49	3.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4(N)	12:49	3.5	Bottom	3	1	29.7	8.2	21.0	7.5	7.5	12.1	13.7	13.3	7.5
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	SR4(N)	12:49	3.5	Bottom	3	2	29.8	8.2	20.9	7.5		12.2		14.0	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS8	12:54	4.1	Surface	1	1	29.7	8.2	21.5	7.6	7.6	13.3	13.7	6.8	7.5
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS8	12:54	4.1	Surface	1	2	29.8	8.2	21.2	7.6		13.4		7.5	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS8	12:54	4.1	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS8	12:54	4.1	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS8	12:54	4.1	Bottom	3	1	29.7	8.2	21.5	6.9	6.9	13.9	13.7	8.2	7.5
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS8	12:54	4.1	Bottom	3	2	29.8	8.2	21.3	6.9		14.0		7.4	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)9	13:03	3.2	Surface	1	1	30.0	8.2	21.5	7.5	7.6	8.3	8.7	5.3	6.0
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)9	13:03	3.2	Surface	1	2	30.1	8.2	21.3	7.6		8.4		4.5	
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)9	13:03	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)9	13:03	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)9	13:03	3.2	Bottom	3	1	30.0	8.2	21.5	7.1	7.1	9.0	8.7	7.0	6.0
TMCLKL	HY/2012/07	2018-07-27	Mid-Ebb	IS(Mf)9	13:03	3.2	Bottom	3	2	30.1	8.2	21.3	7.1		9.1		7.3	

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)5	19:45	12.3	Surface	1	1	29.3	8.0	22.0	6.0	5.6	4.8	5.7	3.1	3.6
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)5	19:45	12.3	Surface	1	2	29.2	8.1	22.3	6.0		4.8		2.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)5	19:45	12.3	Middle	2	1	29.1	8.0	25.6	5.1		5.9		3.9	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)5	19:45	12.3	Middle	2	2	29.0	8.0	25.8	5.1		5.8		3.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)5	19:45	12.3	Bottom	3	1	29.1	8.0	26.2	5.1		6.6		4.7	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)5	19:45	12.3	Bottom	3	2	28.9	8.0	26.4	5.1	5.1	6.5	4.4		
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)3(N)	18:43	7.1	Surface	1	1	30.0	7.7	15.4	5.7	5.6	6.0	6.5	9.2	9.1
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)3(N)	18:43	7.1	Surface	1	2	30.0	7.7	15.1	5.6		5.6		8.4	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)3(N)	18:43	7.1	Middle	2	1	30.0	7.7	17.2	5.6		6.2		9.1	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)3(N)	18:43	7.1	Middle	2	2	30.0	7.7	17.0	5.5		6.2		9.0	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)3(N)	18:43	7.1	Bottom	3	1	29.9	7.7	17.8	5.6		7.2		9.8	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	CS(Mf)3(N)	18:43	7.1	Bottom	3	2	29.9	7.8	17.6	5.5	5.6	7.9	9.1		
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)16	19:19	5.6	Surface	1	1	29.8	8.1	20.9	6.9	6.9	9.2	11.0	5.5	6.6
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)16	19:19	5.6	Surface	1	2	29.7	8.1	21.1	6.9		9.0		6.1	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)16	19:19	5.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)16	19:19	5.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)16	19:19	5.6	Bottom	3	1	29.9	8.1	21.1	6.9		6.9		12.9	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)16	19:19	5.6	Bottom	3	2	29.7	8.1	21.3	6.9	6.9	12.8	7.7		
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4a	19:09	4.6	Surface	1	1	29.9	8.0	20.2	6.9	6.9	14.6	15.8	11.7	11.9
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4a	19:09	4.6	Surface	1	2	29.8	8.1	20.4	6.9		14.5		11.9	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4a	19:09	4.6	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4a	19:09	4.6	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4a	19:09	4.6	Bottom	3	1	29.9	8.0	20.3	6.8		6.8		17.0	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4a	19:09	4.6	Bottom	3	2	29.8	8.1	20.5	6.8	6.8	17.0	12.0		
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4(N)	19:05	3.2	Surface	1	1	30.0	8.1	20.7	7.2	7.2	21.0	21.3	17.6	18.3
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4(N)	19:05	3.2	Surface	1	2	29.8	8.1	20.9	7.2		20.9		18.3	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4(N)	19:05	3.2	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4(N)	19:05	3.2	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4(N)	19:05	3.2	Bottom	3	1	30.0	8.1	20.6	7.2		7.2		21.7	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	SR4(N)	19:05	3.2	Bottom	3	2	29.8	8.1	20.8	7.2	7.2	21.6	19.1		
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS8	18:59	3.9	Surface	1	1	29.6	8.1	21.0	6.5	6.5	21.4	21.6	14.4	14.5
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS8	18:59	3.9	Surface	1	2	29.5	8.0	22.0	6.4		21.3		14.1	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS8	18:59	3.9	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS8	18:59	3.9	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS8	18:59	3.9	Bottom	3	1	29.5	7.9	22.4	5.4		5.4		21.8	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS8	18:59	3.9	Bottom	3	2	29.3	8.1	22.6	5.4	5.4	21.7	14.7		
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)9	18:53	2.8	Surface	1	1					7.5		6.6		8.2
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)9	18:53	2.8	Surface	1	2									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)9	18:53	2.8	Middle	2	1	30.1	8.1	21.0	7.5		6.6		8.5	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)9	18:53	2.8	Middle	2	2	29.9	8.2	21.2	7.5		6.6		7.8	
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)9	18:53	2.8	Bottom	3	1									
TMCLKL	HY/2012/07	2018-07-27	Mid-Flood	IS(Mf)9	18:53	2.8	Bottom	3	2									

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)5	14:24	12.3	Surface	1	1	30.4	8.0	20.9	6.5	5.9	5.2	9.3	9.2	10.6
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)5	14:24	12.3	Surface	1	2	30.2	8.0	21.1	6.6		5.7		10.1	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)5	14:24	12.3	Middle	2	1	29.7	7.9	23.9	5.2		11.6		10.8	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)5	14:24	12.3	Middle	2	2	29.5	8.0	24.1	5.3		11.7		11.0	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)5	14:24	12.3	Bottom	3	1	28.9	7.9	27.9	4.4		10.6		11.6	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)5	14:24	12.3	Bottom	3	2	28.7	8.0	28.1	4.4	4.4	10.8	10.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)3(N)	13:10	7.3	Surface	1	1	30.5	8.1	18.2	5.5	5.3	10.5	12.3	3.4	3.8
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)3(N)	13:10	7.3	Surface	1	2	30.6	8.0	18.4	5.5		10.1		3.6	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)3(N)	13:10	7.3	Middle	2	1	29.9	8.1	21.1	5.2		14.1		3.6	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)3(N)	13:10	7.3	Middle	2	2	29.9	8.0	21.0	5.1		14.4		3.7	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)3(N)	13:10	7.3	Bottom	3	1	29.8	8.1	21.7	5.5		12.4		4.6	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	CS(Mf)3(N)	13:10	7.3	Bottom	3	2	29.9	8.0	21.6	5.5	5.5	12.4	4.1		
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)16	14:00	5.7	Surface	1	1	30.6	8.0	21.2	6.7	6.7	5.3	5.7	8.4	8.4
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)16	14:00	5.7	Surface	1	2	30.4	8.0	21.4	6.7		5.2		7.9	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)16	14:00	5.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)16	14:00	5.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)16	14:00	5.7	Bottom	3	1	29.7	7.9	22.8	5.5		5.5		6.2	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)16	14:00	5.7	Bottom	3	2	29.5	8.0	23.9	5.5	5.5	6.1	8.7		
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4a	13:47	5.0	Surface	1	1	30.3	7.9	20.4	6.0	6.0	8.6	10.0	8.5	9.5
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4a	13:47	5.0	Surface	1	2	30.1	8.0	20.6	6.0		8.3		7.7	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4a	13:47	5.0	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4a	13:47	5.0	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4a	13:47	5.0	Bottom	3	1	30.0	7.9	21.9	5.1		5.1		11.8	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4a	13:47	5.0	Bottom	3	2	29.8	8.0	22.1	5.1	5.1	11.3	10.3		
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4(N)	13:42	3.7	Surface	1	1	30.6	7.9	19.7	6.5	6.5	8.5	10.0	9.5	9.4
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4(N)	13:42	3.7	Surface	1	2	30.4	8.0	19.9	6.5		8.2		9.5	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4(N)	13:42	3.7	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4(N)	13:42	3.7	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4(N)	13:42	3.7	Bottom	3	1	30.4	8.0	20.1	6.4		6.4		11.5	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	SR4(N)	13:42	3.7	Bottom	3	2	30.2	8.0	20.3	6.4	6.4	11.7	9.6		
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS8	13:35	4.4	Surface	1	1	30.7	8.1	20.1	7.7	7.7	12.1	12.6	6.0	6.5
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS8	13:35	4.4	Surface	1	2	30.5	8.0	20.3	7.7		12.0		6.7	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS8	13:35	4.4	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS8	13:35	4.4	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS8	13:35	4.4	Bottom	3	1	30.6	8.0	20.5	7.2		7.3		13.0	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS8	13:35	4.4	Bottom	3	2	30.4	8.0	20.7	7.3	7.3	13.1	7.1		
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)9	13:26	4.5	Surface	1	1	30.4	8.1	20.4	7.4	7.4	9.0	10.5	3.8	4.5
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)9	13:26	4.5	Surface	1	2	30.2	8.0	20.6	7.4		9.8		3.7	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)9	13:26	4.5	Middle	2	1									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)9	13:26	4.5	Middle	2	2									
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)9	13:26	4.5	Bottom	3	1	30.4	8.0	21.0	6.2		6.2		11.5	
TMCLKL	HY/2012/07	2018-07-30	Mid-Ebb	IS(Mf)9	13:26	4.5	Bottom	3	2	30.2	8.0	21.2	6.2	6.2	11.6	5.6		



Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Depth (m)	Level	Level Code	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)5	7:16	12.2	Surface	1	1	30.1	8.0	20.0	5.6	5.4	3.8	6.2	6.1	6.3	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)5	7:16	12.2	Surface	1	2	30.1	7.9	19.7	5.6		3.4		5.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)5	7:16	12.2	Middle	2	1	29.3	8.1	24.5	5.1		5.6		6.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)5	7:16	12.2	Middle	2	2	29.3	7.9	24.3	5.1	4.5	5.1		6.0		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)5	7:16	12.2	Bottom	3	1	28.9	8.0	28.6	4.5		9.4		6.4		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)5	7:16	12.2	Bottom	3	2	28.9	7.8	28.2	4.5	5.6	9.8		6.9		10.9
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)3(N)	8:27	7.2	Surface	1	1	30.3	8.0	16.6	5.7		9.2	4.6			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)3(N)	8:27	7.2	Surface	1	2	30.3	8.0	16.5	5.7		9.0	4.9			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)3(N)	8:27	7.2	Middle	2	1	30.2	8.0	17.3	5.5	5.4	11.3	4.3			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)3(N)	8:27	7.2	Middle	2	2	30.2	8.1	17.0	5.6		11.3	5.2			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)3(N)	8:27	7.2	Bottom	3	1	30.2	8.0	18.9	5.4	6.2	12.0	4.4	4.0	3.4	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	CS(Mf)3(N)	8:27	7.2	Bottom	3	2	30.2	8.1	18.6	5.4		12.4	3.4			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)16	7:42	5.9	Surface	1	1	30.1	8.1	19.9	6.2		6.1	3.6		5.4	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)16	7:42	5.9	Surface	1	2	30.0	8.0	19.7	6.2	4.1		3.4			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)16	7:42	5.9	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)16	7:42	5.9	Middle	2	2					6.1		5.4			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)16	7:42	5.9	Bottom	3	1	30.0	8.1	20.6	6.1		3.9	4.5			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)16	7:42	5.9	Bottom	3	2	30.0	8.0	20.4	6.1	5.9	4.2	4.8	4.5	6.4	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4a	7:52	4.6	Surface	1	1	30.1	8.1	18.9	5.9		4.1		5.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4a	7:52	4.6	Surface	1	2	30.1	8.0	18.7	5.9		4.7		5.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4a	7:52	4.6	Surface	1	1					5.8			6.7		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4a	7:52	4.6	Middle	2	1						5.2		7.2		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4a	7:52	4.6	Bottom	3	2	30.1	8.0	19.0	5.8		5.2				
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4(N)	7:58	3.8	Surface	1	1	30.0	8.1	19.7	5.7	5.7	5.1	5.5	5.8	6.6	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4(N)	7:58	3.8	Surface	1	2	30.0	8.0	19.5	5.7		5.9		6.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4(N)	7:58	3.8	Middle	2	1										
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4(N)	7:58	3.8	Middle	2	2					5.8			6.5		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4(N)	7:58	3.8	Bottom	3	1	30.0	8.1	19.7	5.8		5.1		7.2		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	SR4(N)	7:58	3.8	Bottom	3	2	30.0	8.0	19.5	5.8	5.8	5.9		5.6		4.4
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS8	8:07	4.3	Surface	1	1	30.1	8.1	19.0	5.8		4.0	4.7			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS8	8:07	4.3	Surface	1	2	30.0	8.0	18.8	5.8		4.7	4.7			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS8	8:07	4.3	Middle	2	1					5.8		5.1			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS8	8:07	4.3	Middle	2	2						6.4	6.2			
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS8	8:07	4.3	Bottom	3	1	30.1	8.1	21.2	5.7		7.2				
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS8	8:07	4.3	Bottom	3	2	30.1	8.0	21.0	5.8	6.2	4.5	4.8	3.8	4.4	
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)9	8:14	3.6	Surface	1	1	30.1	8.2	20.8	6.2		4.4		4.6		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)9	8:14	3.6	Surface	1	2	30.1	8.0	20.5	6.2						
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)9	8:14	3.6	Middle	2	1					6.2			4.8		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)9	8:14	3.6	Middle	2	2						5.1		4.2		
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)9	8:14	3.6	Bottom	3	1	30.1	8.2	21.0	6.2	6.2	5.0				
TMCLKL	HY/2012/07	2018-07-30	Mid-Flood	IS(Mf)9	8:14	3.6	Bottom	3	2	30.1	8.0	20.8	6.2						

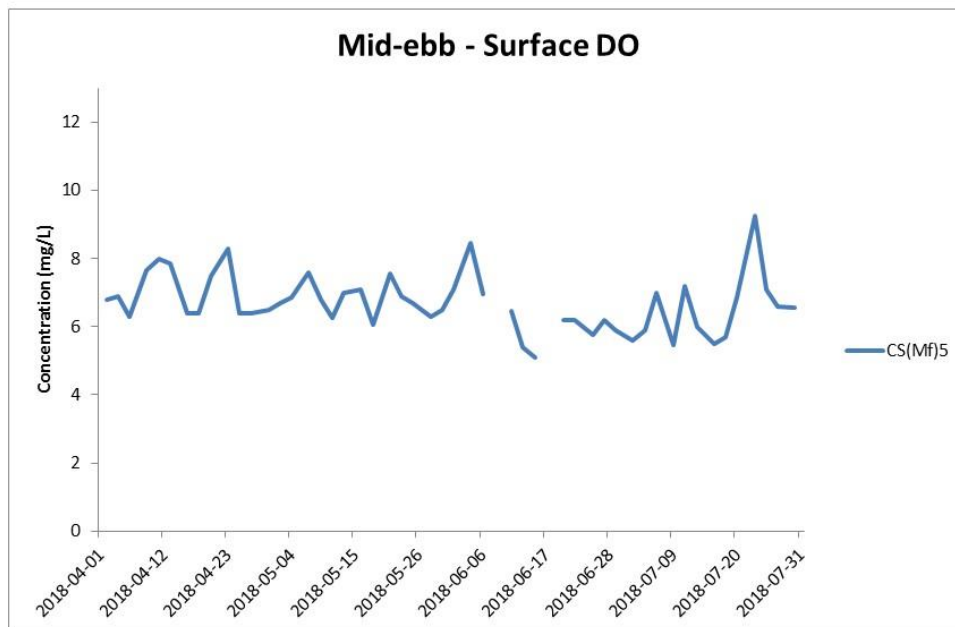
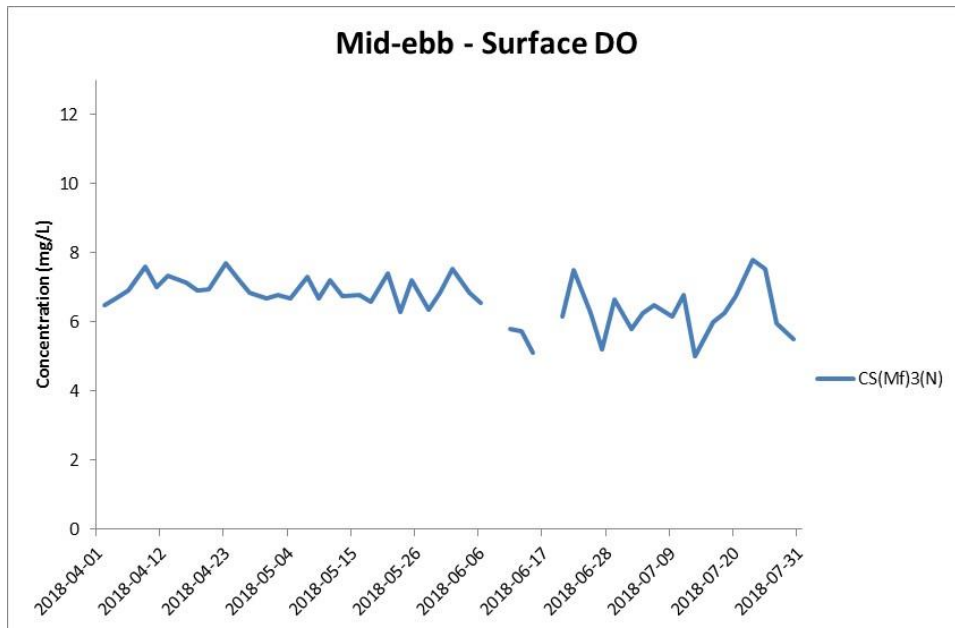


**Figure J1 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-ebb tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



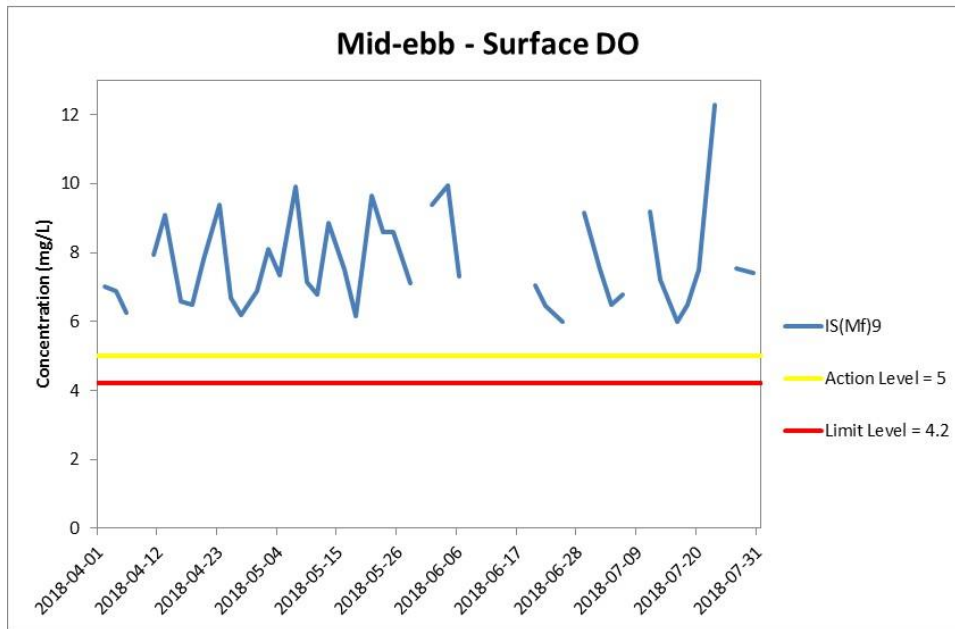
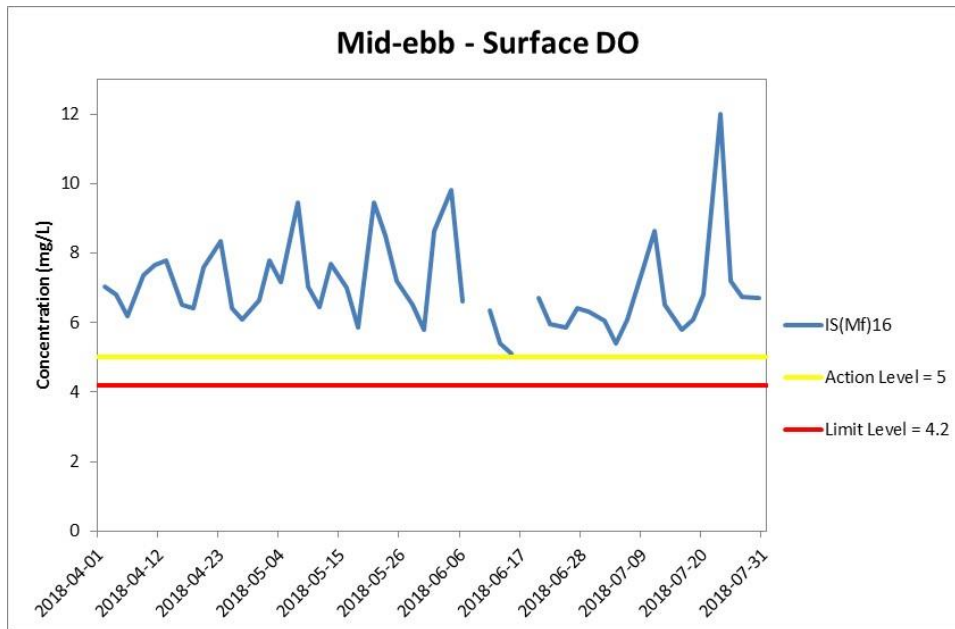


**Figure J2 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-ebb tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.) WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.*

**Environmental  
Resources  
Management**



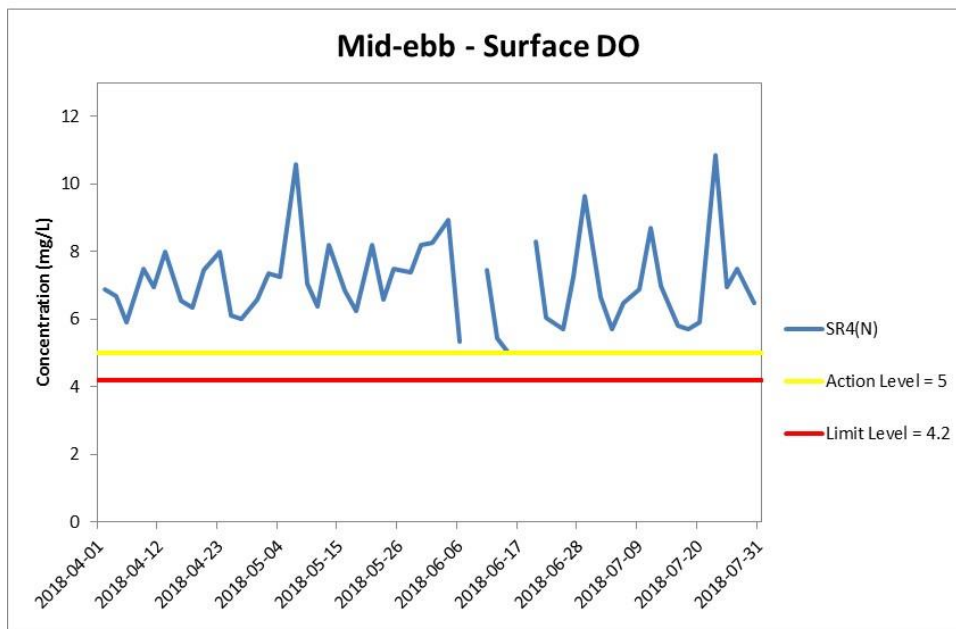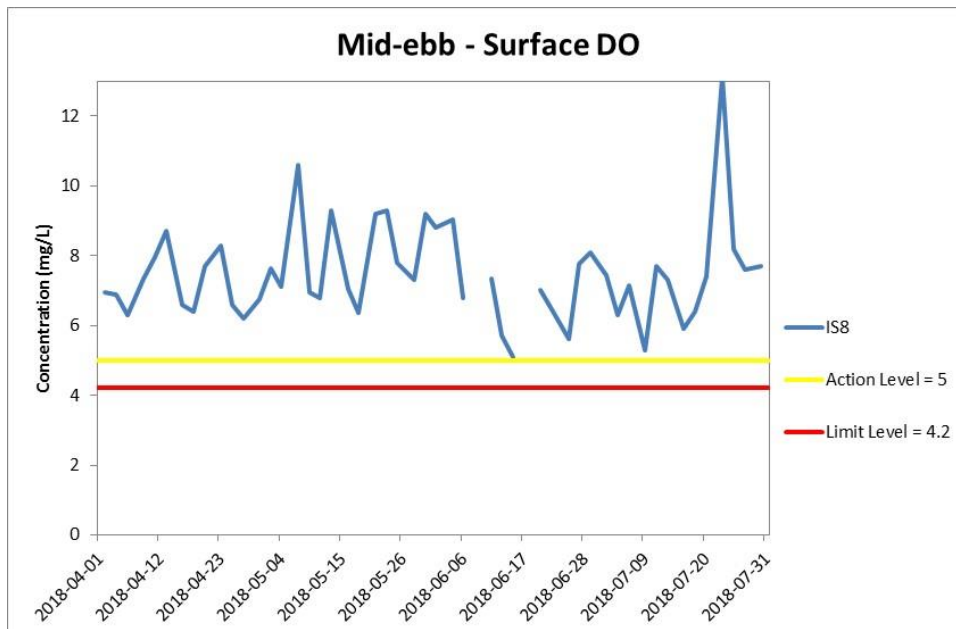


**Figure J3 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-ebb tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**




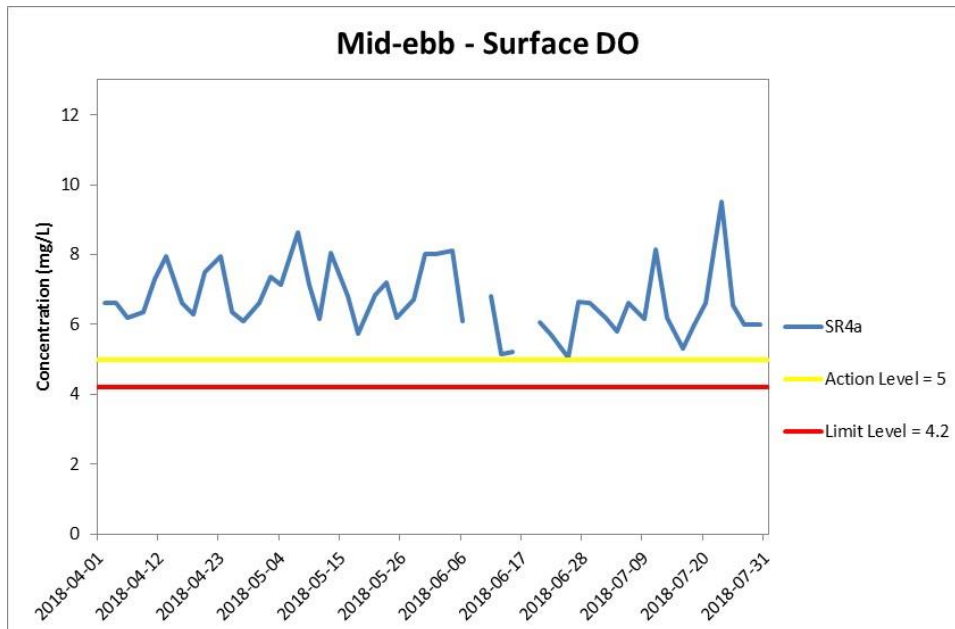


**Figure J4 Impact Monitoring – Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-ebb tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



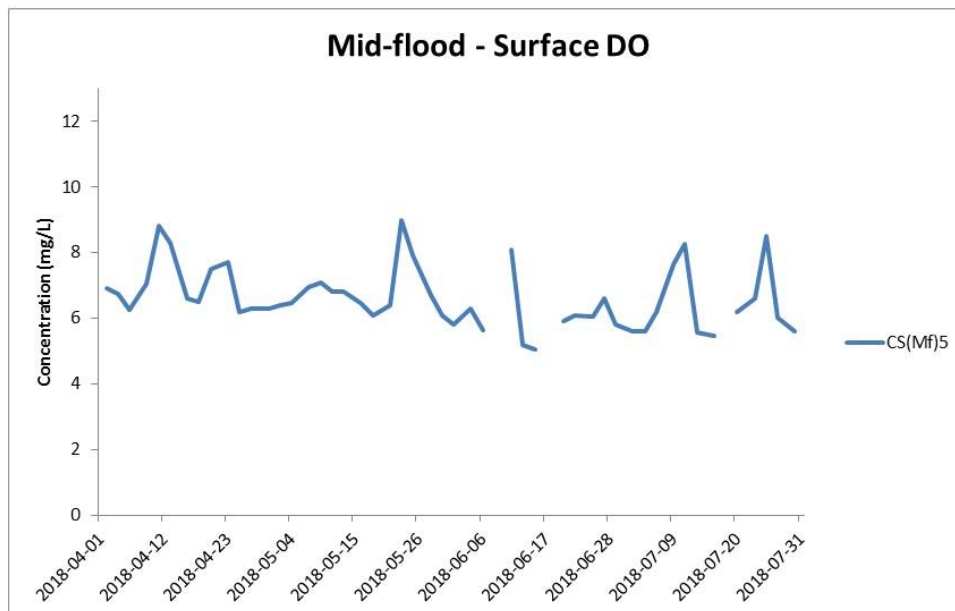
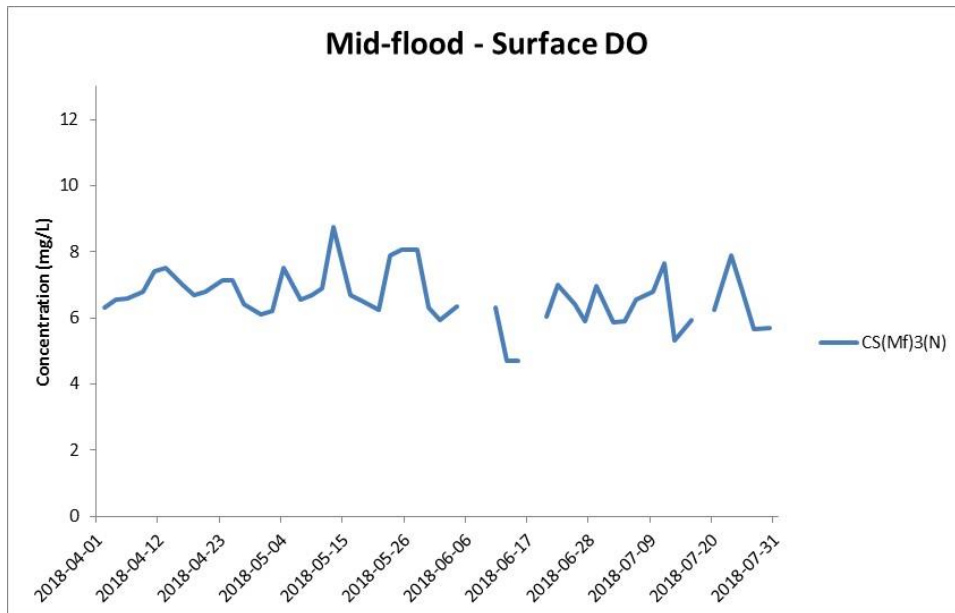


**Figure J5 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-flood tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



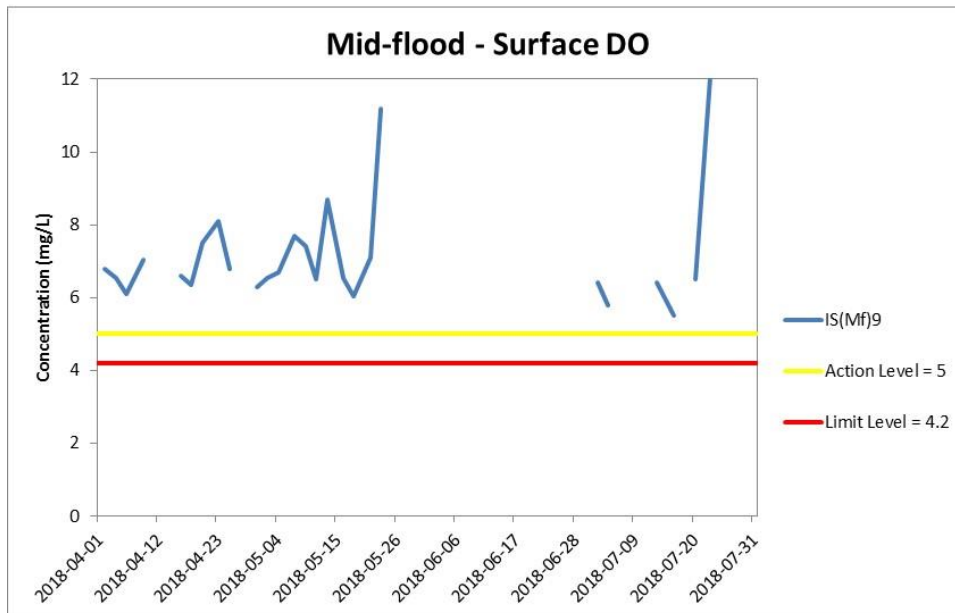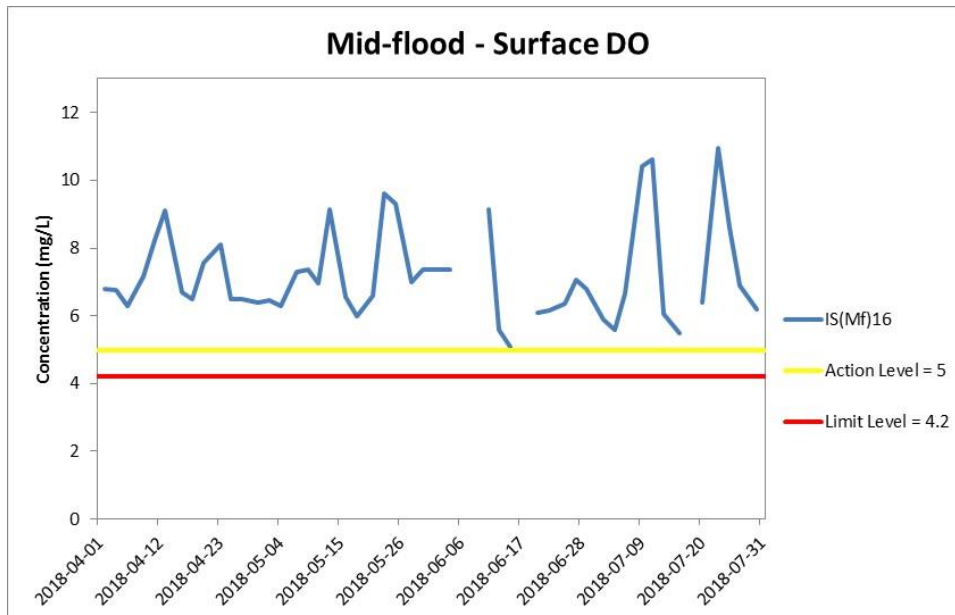



**Figure J6 Impact Monitoring – Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-flood tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*

*WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.*

**Environmental  
Resources  
Management**



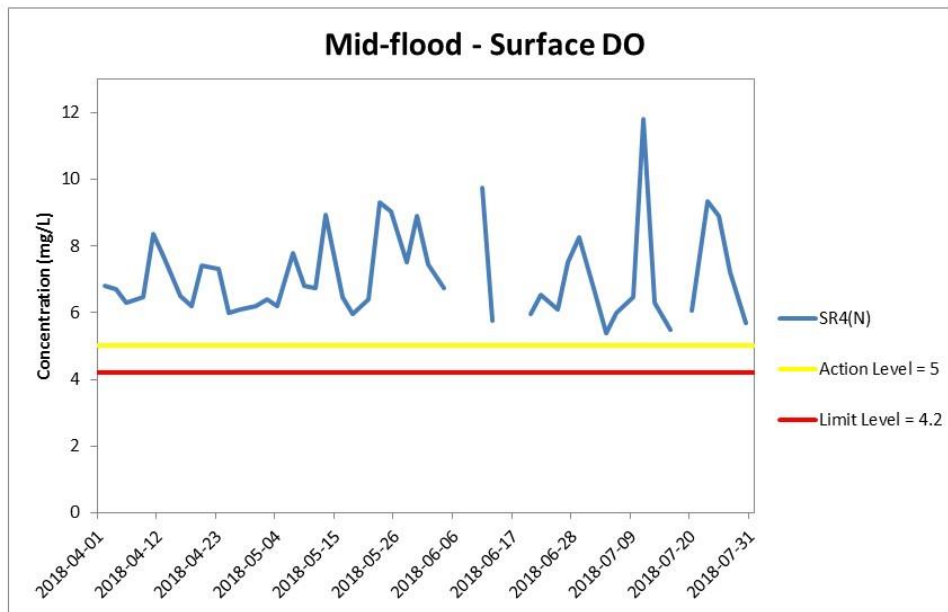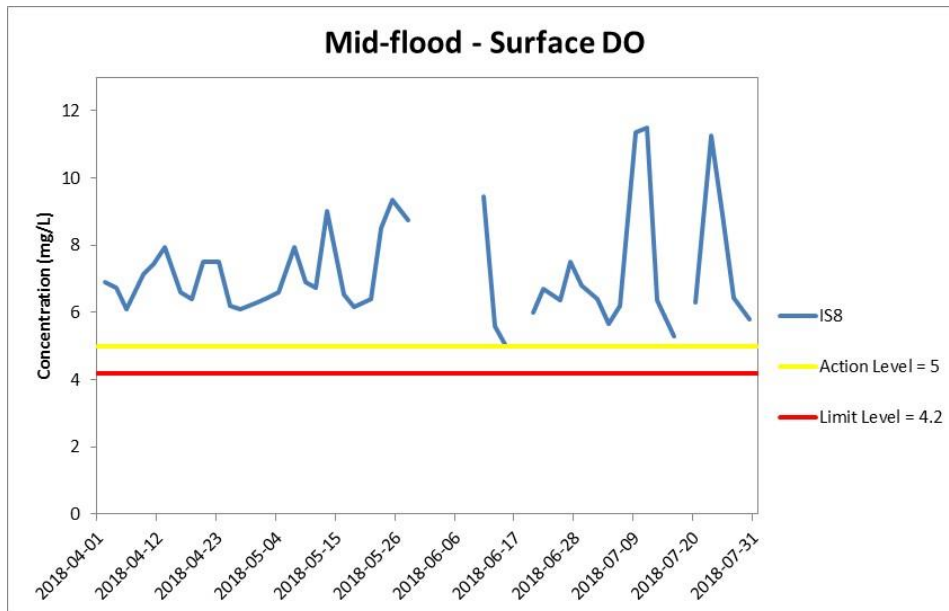


**Figure J7 Impact Monitoring – Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-flood tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)* WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**





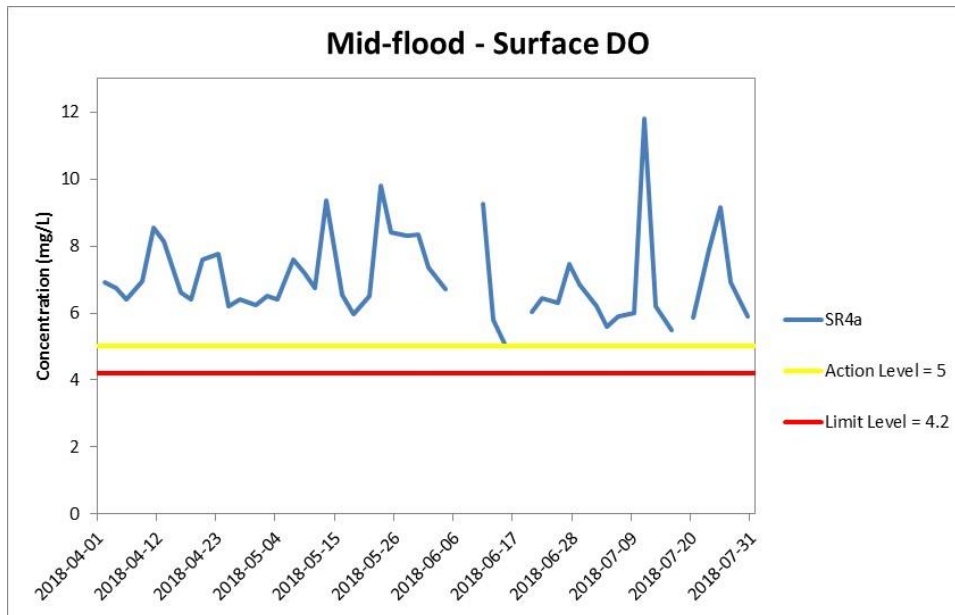


**Figure J8 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in surface waters during mid-flood tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**




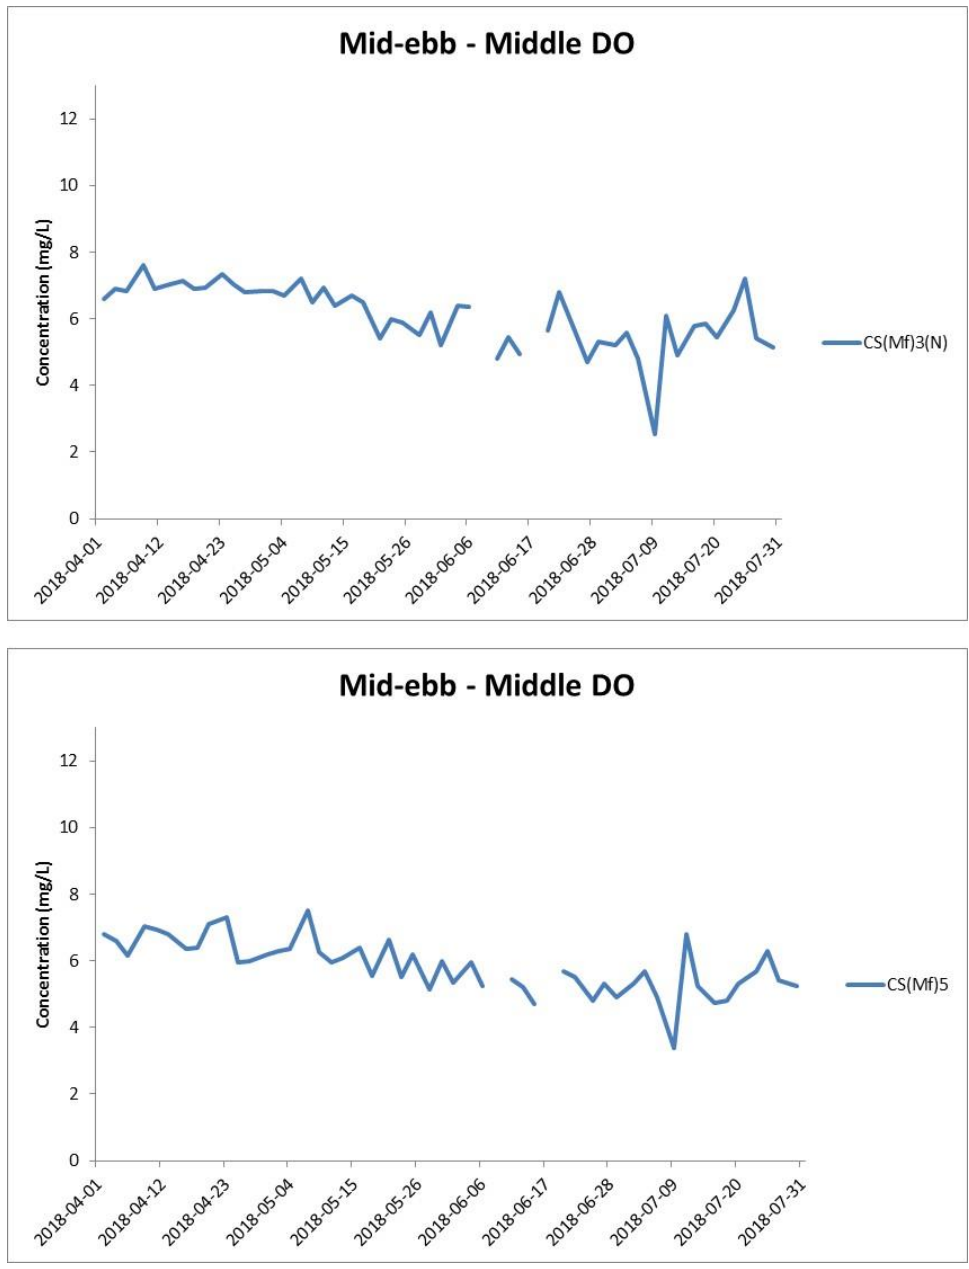


**Figure J9 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in mid-depth waters during mid-ebb tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



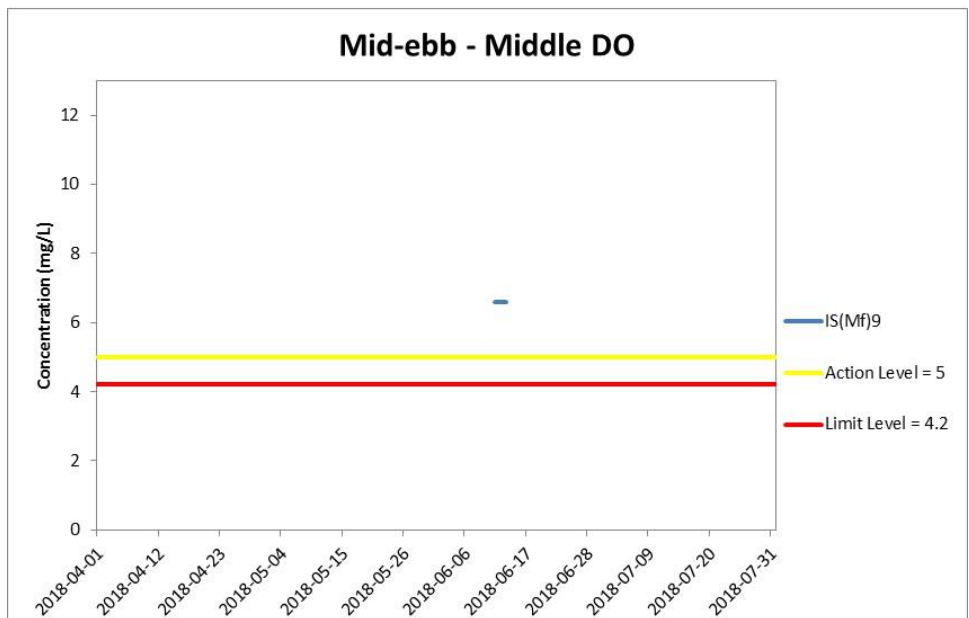
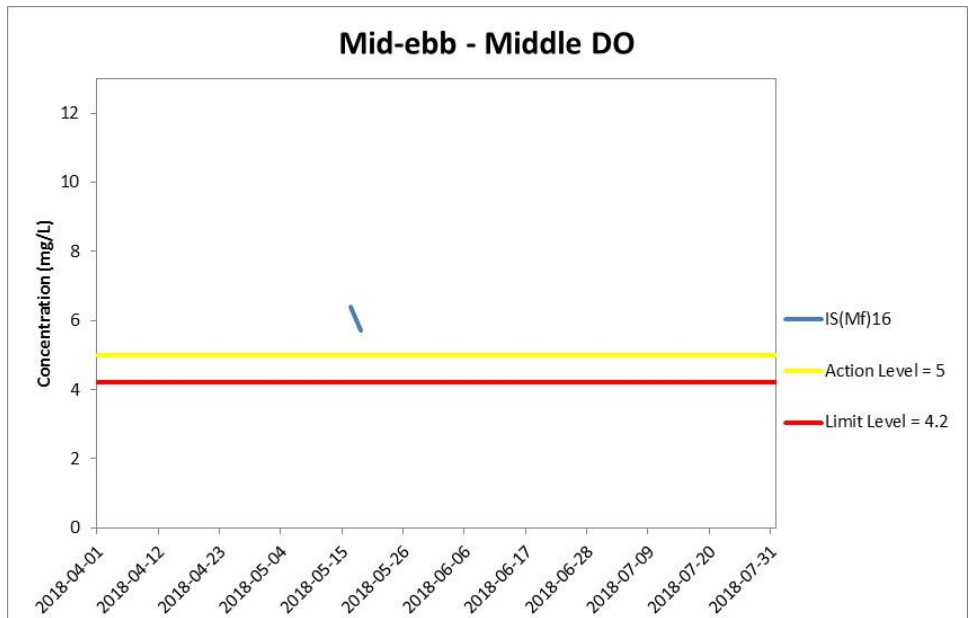


**Figure J10 Impact Monitoring – Mean Level of Dissolved Oxygen (mg/L) in mid-depth waters during mid-ebb tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



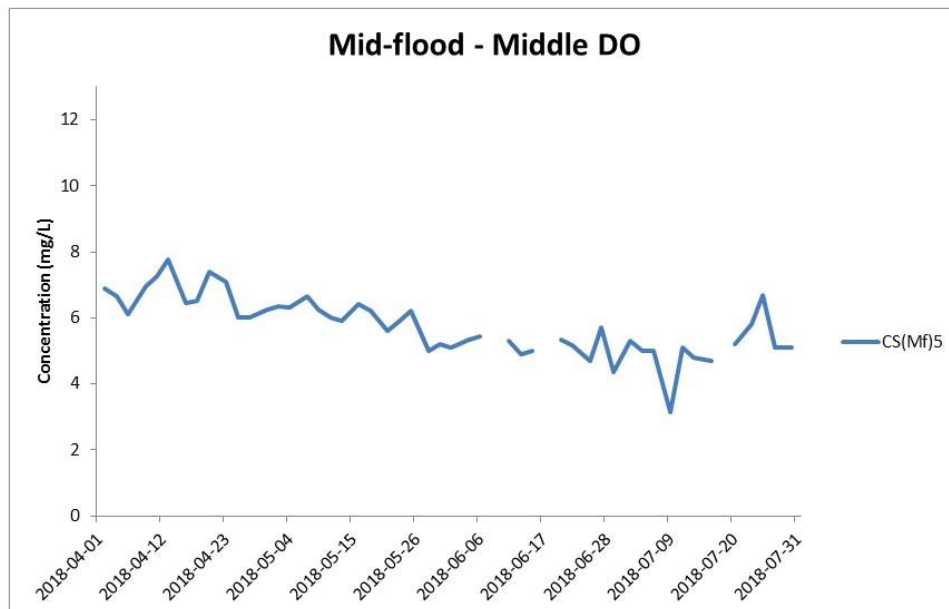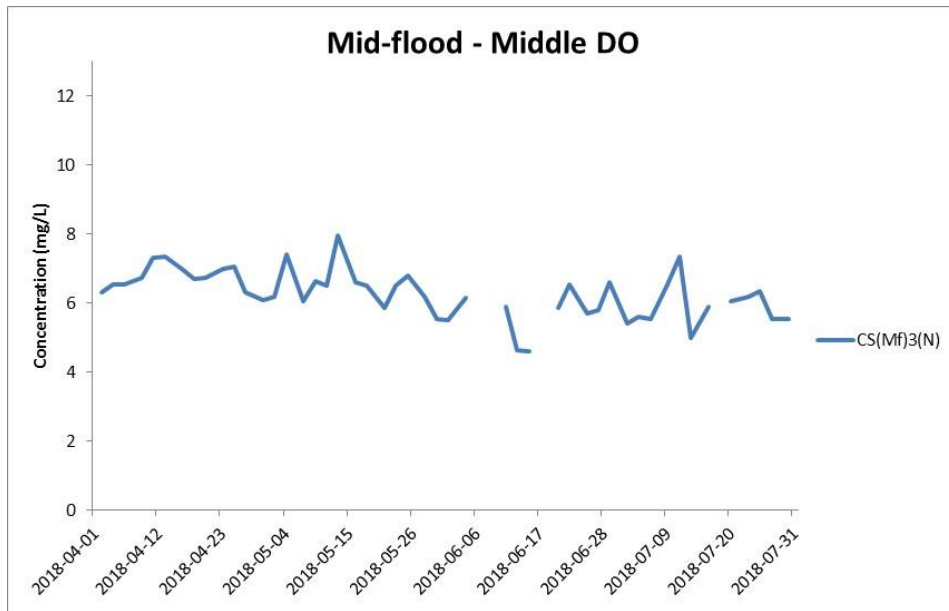


**Figure J11 Impact Monitoring – Mean Level of Dissolved Oxygen (mg/L) in mid-depth waters during mid-flood tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



**ERM**


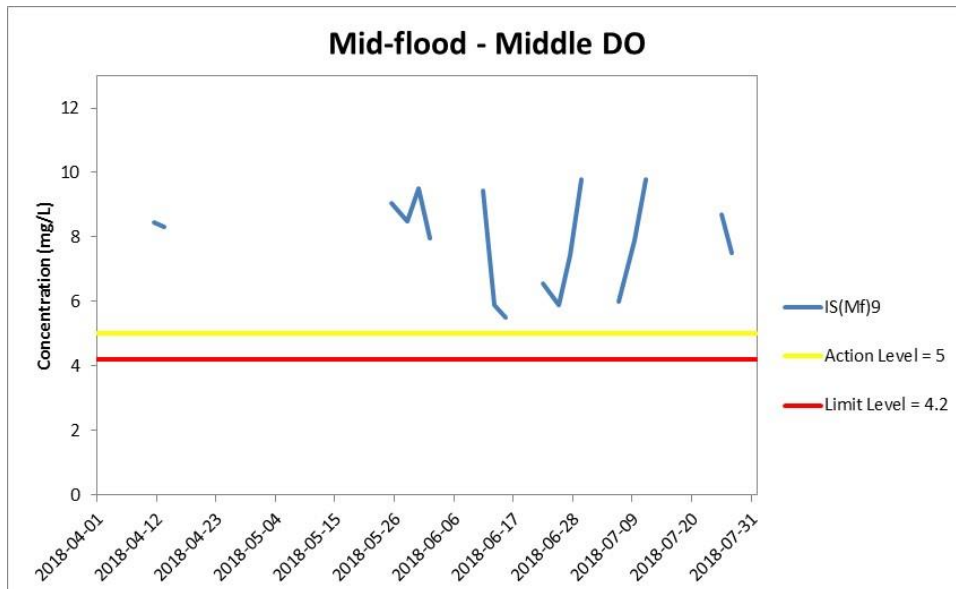


**Figure J12 Impact Monitoring – Mean Level of Dissolved Oxygen (mg/L) in mid-depth waters during mid-flood tide between 1 April and 31 July 2018 at IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



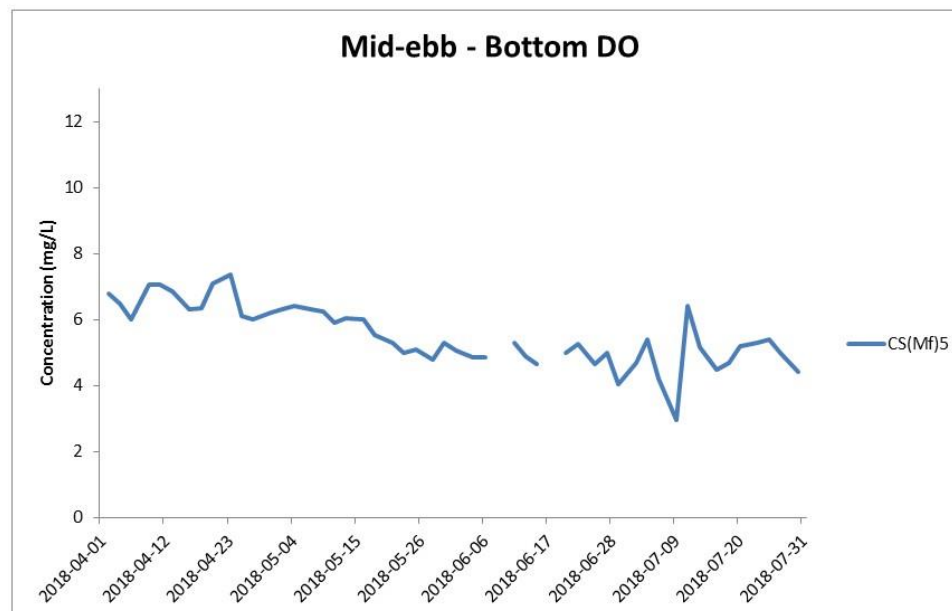
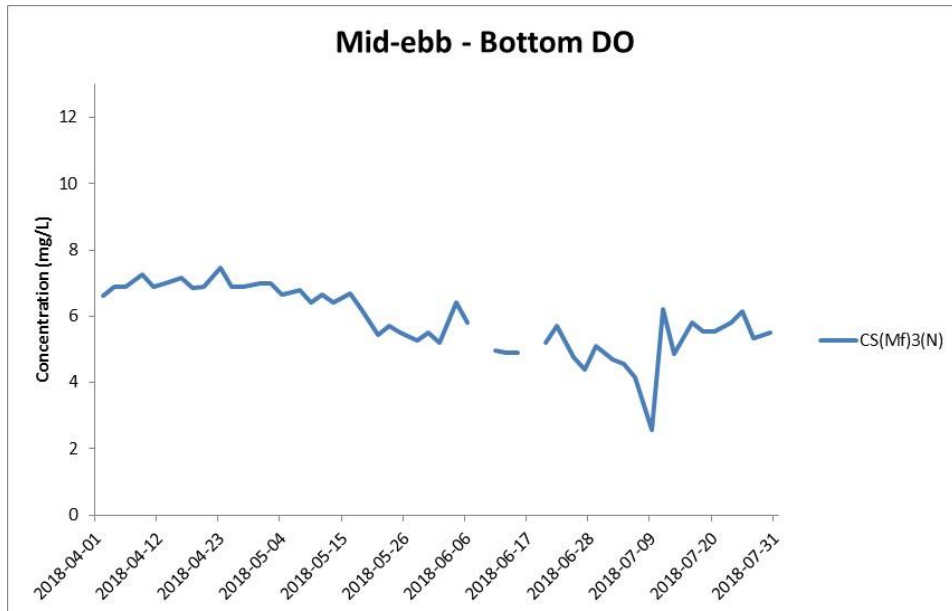


**Figure J13 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-ebb tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



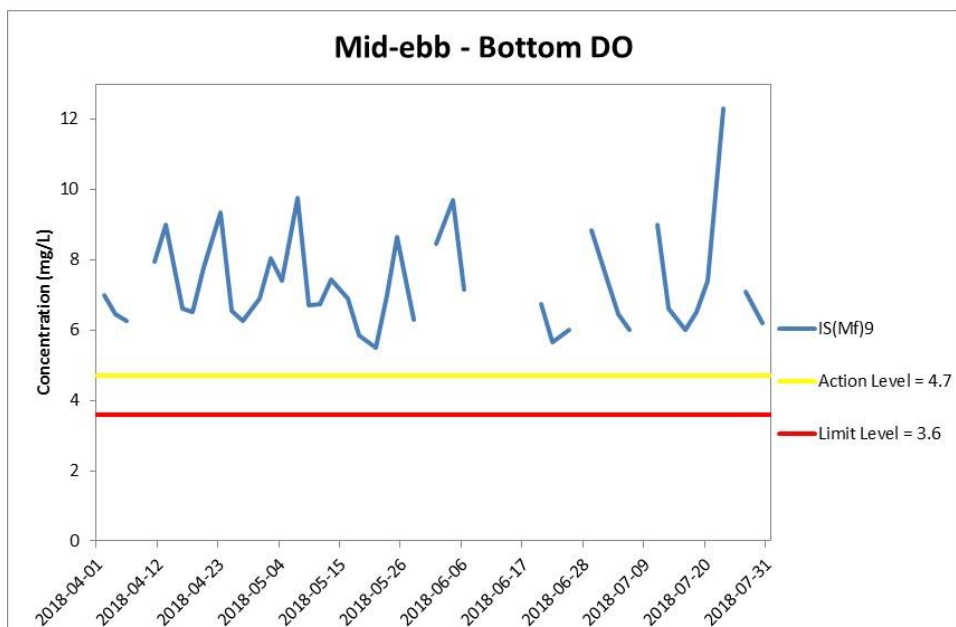
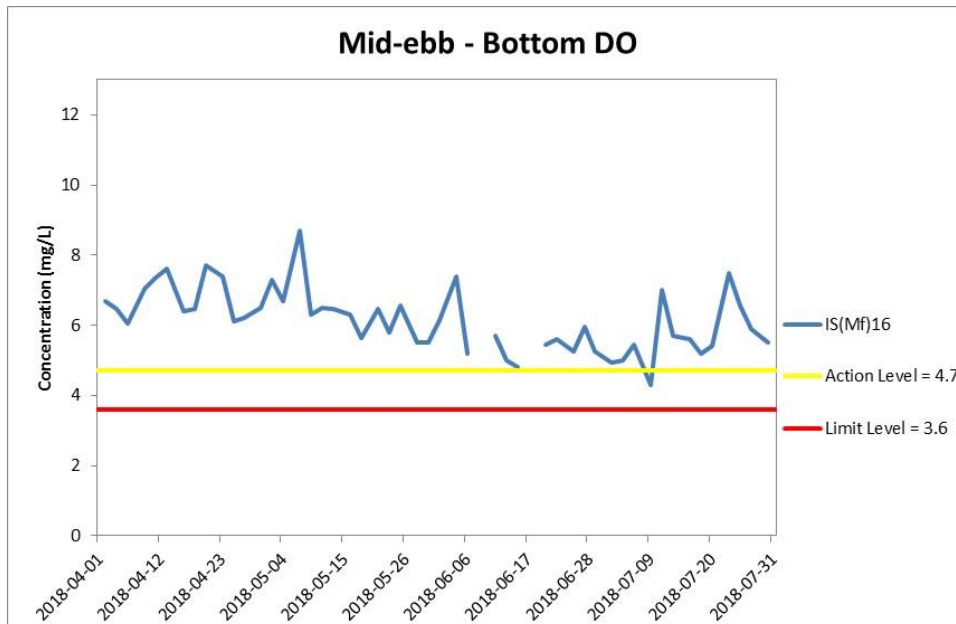


**Figure J14 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-ebb tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



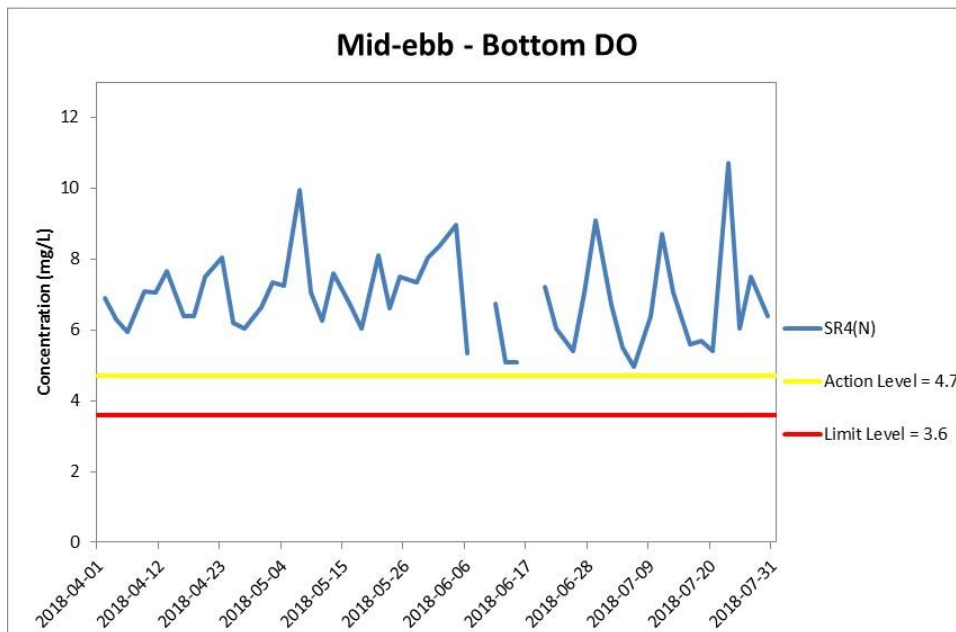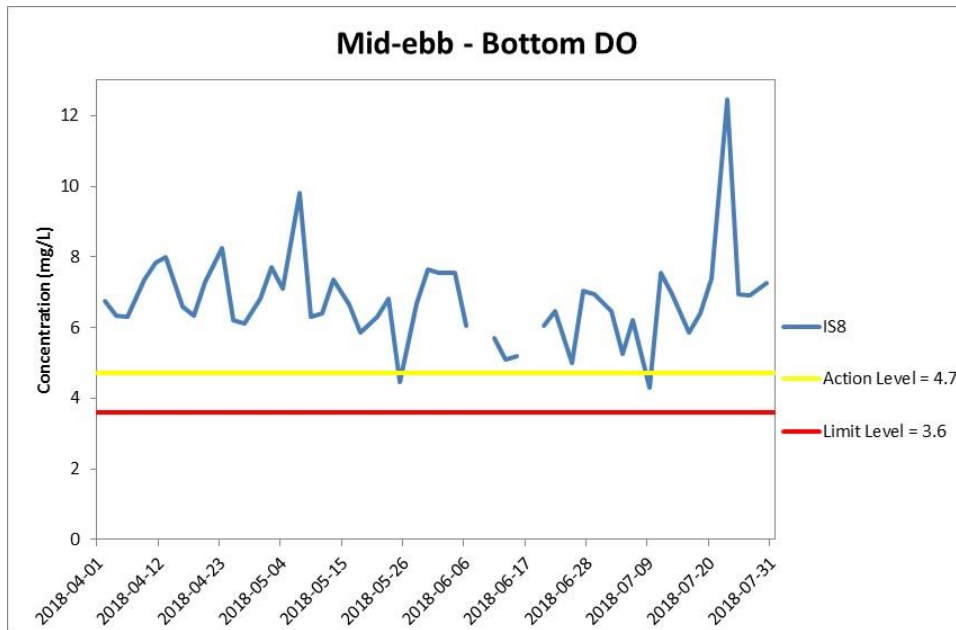


**Figure J15 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-ebb tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**






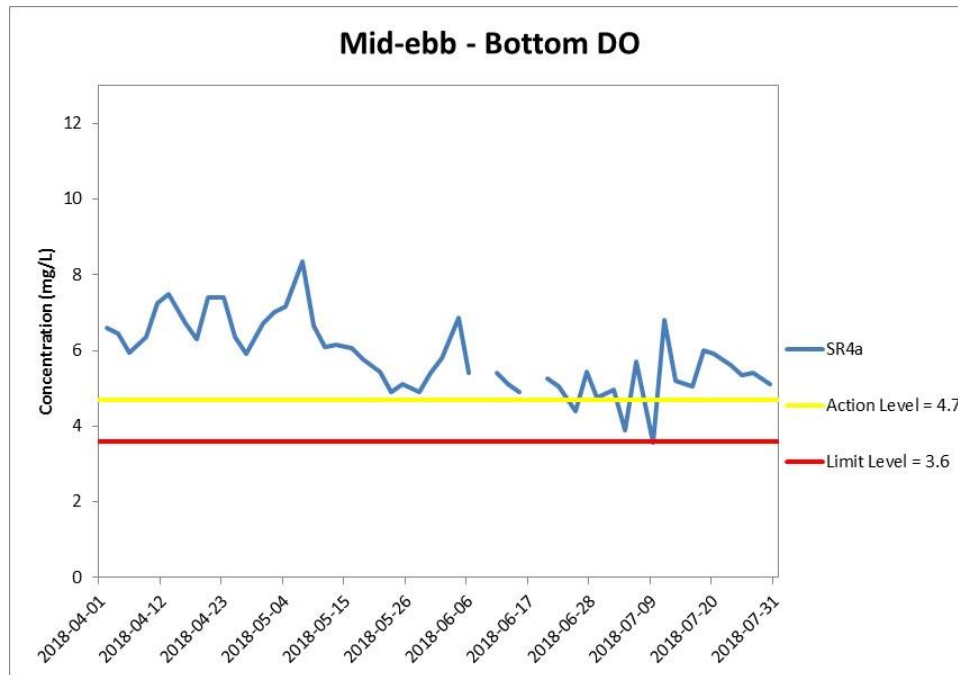


**Figure J16 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-ebb tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



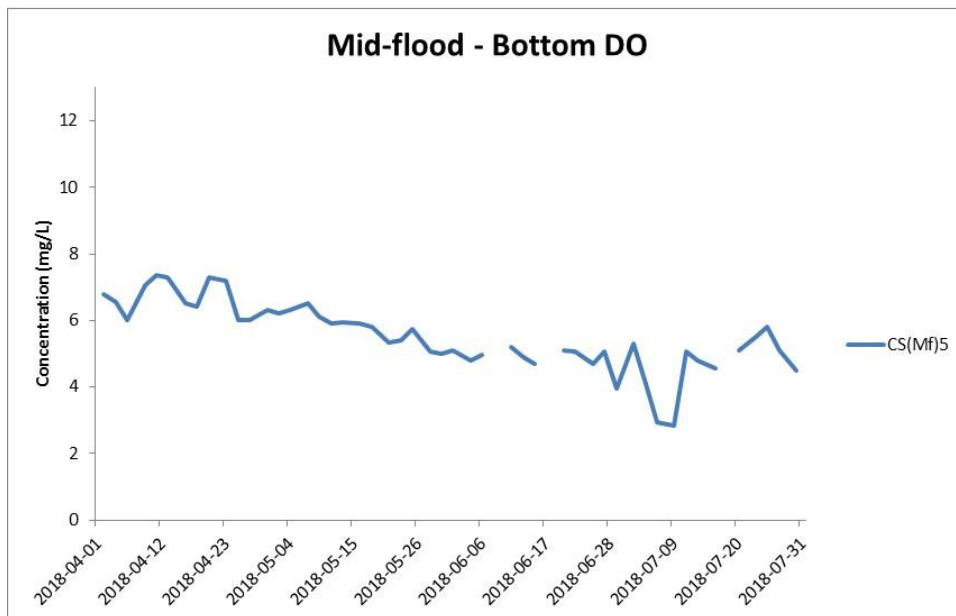
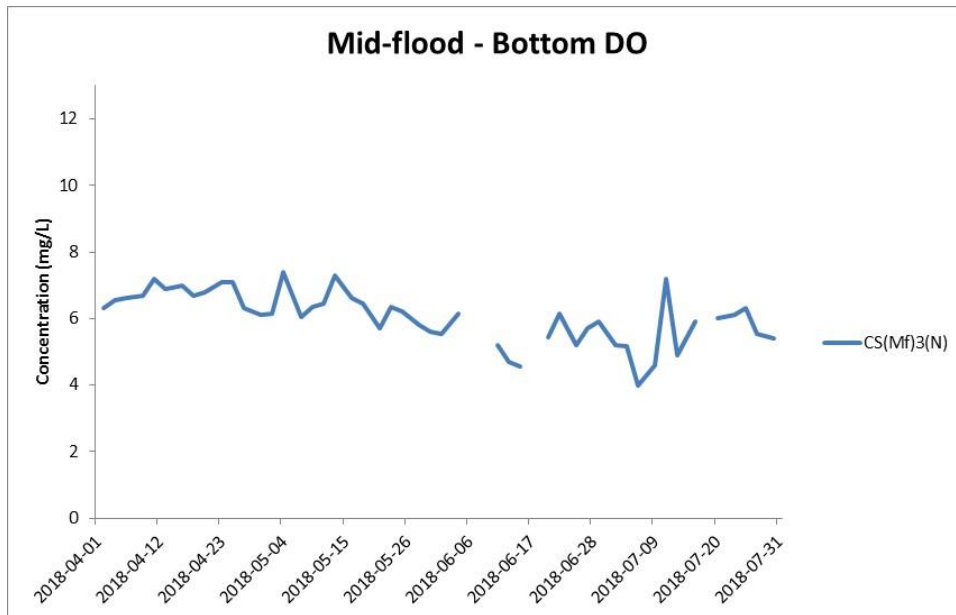


**Figure J17 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-flood tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



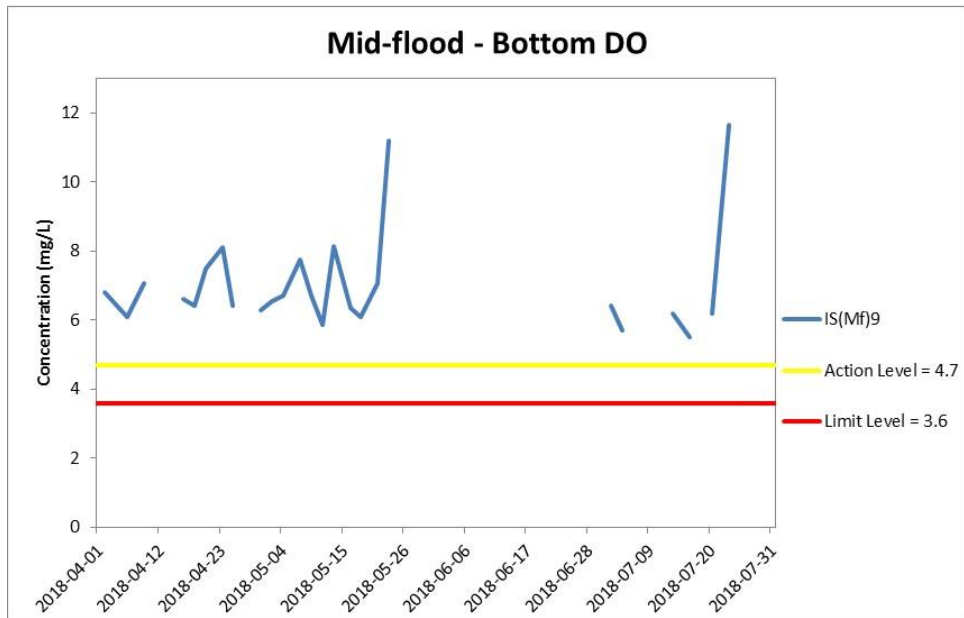
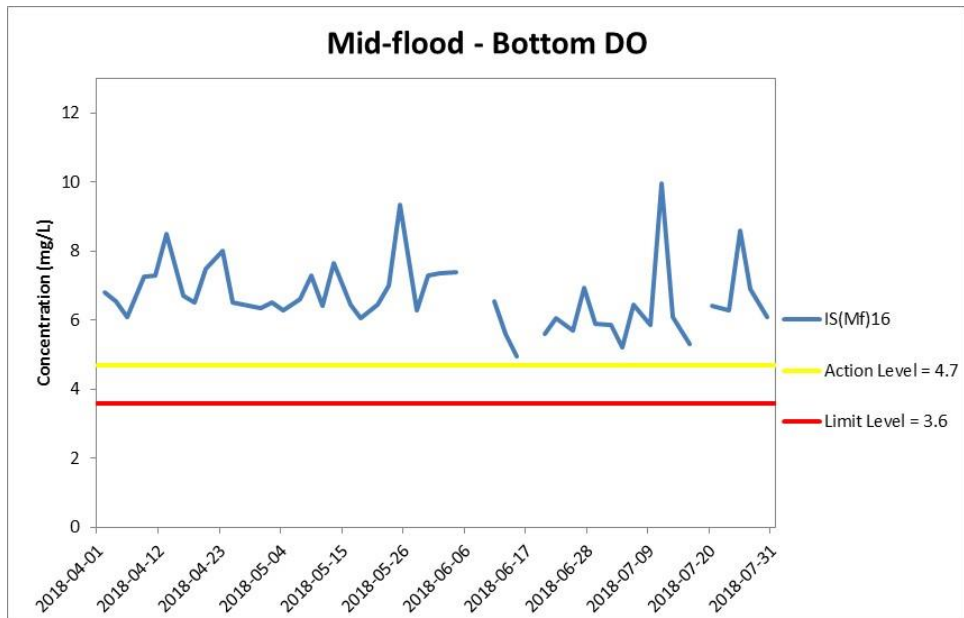


**Figure J18 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-flood tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



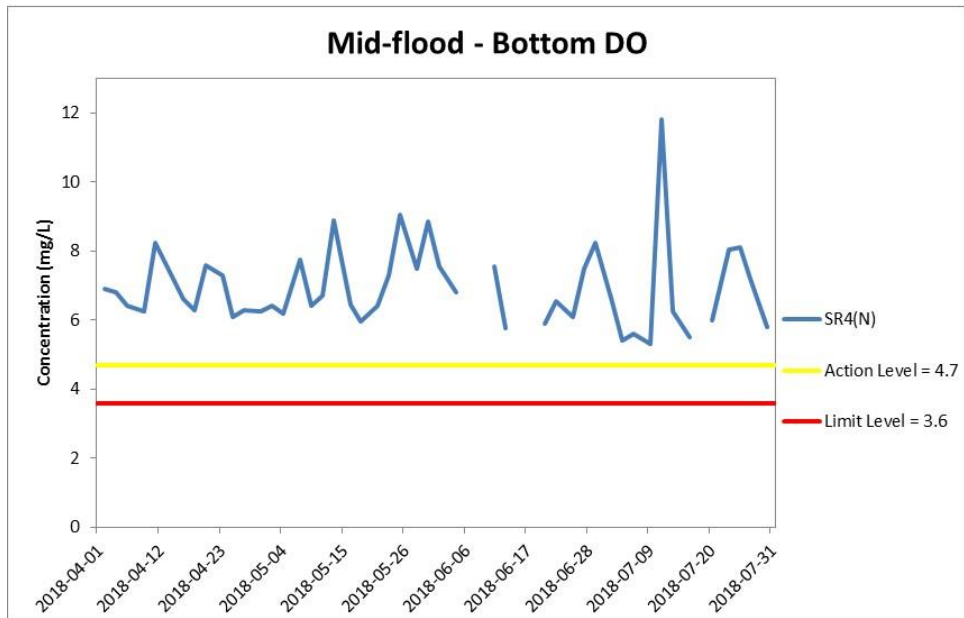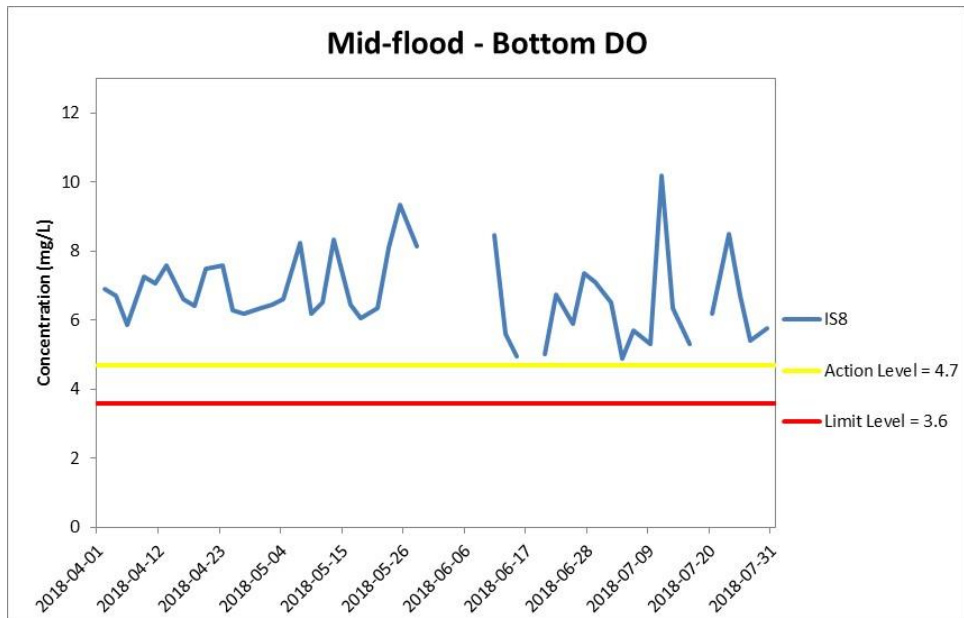


**Figure J19 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-flood tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**




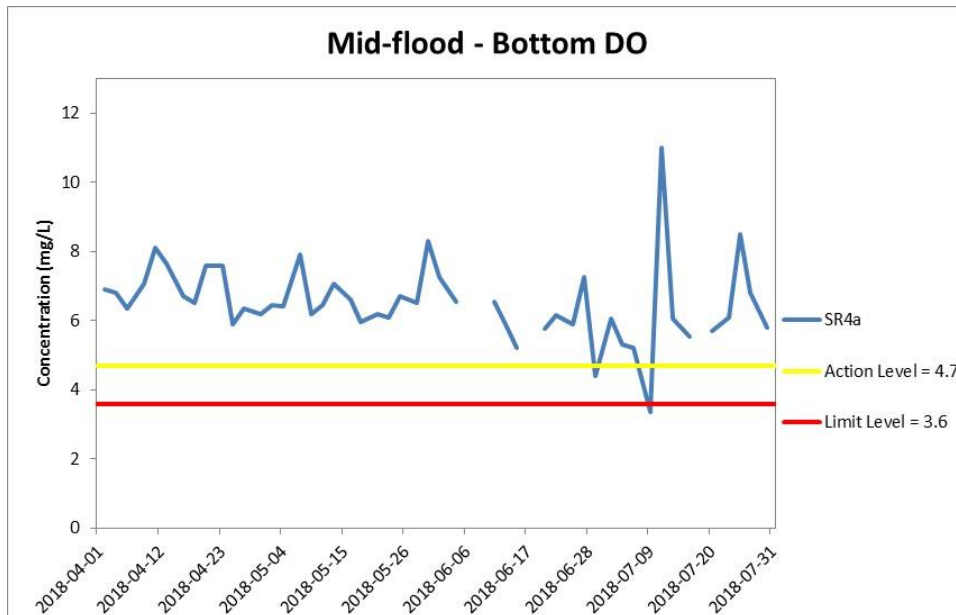


**Figure J20 Impact Monitoring - Mean Level of Dissolved Oxygen (mg/L) in bottom waters during mid-flood tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



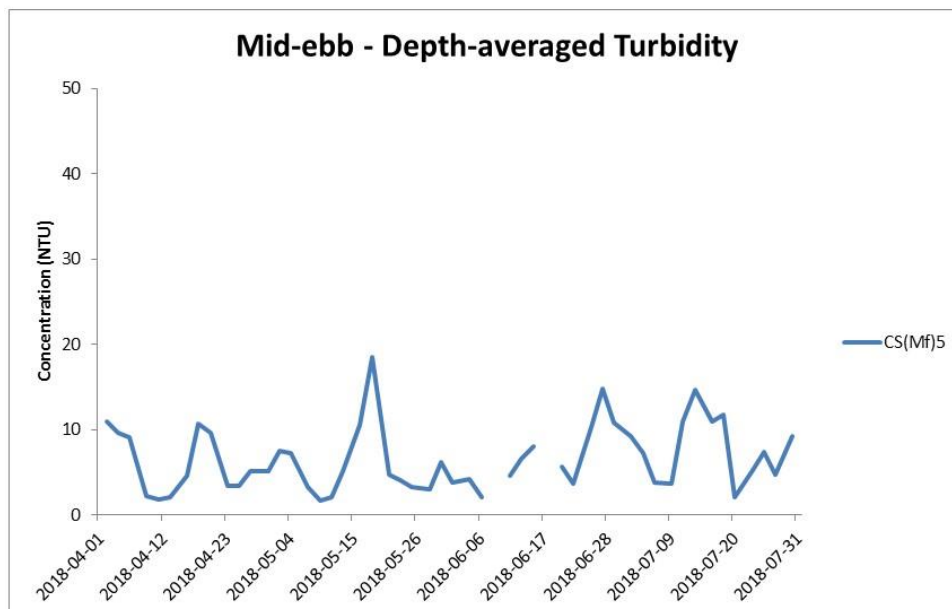
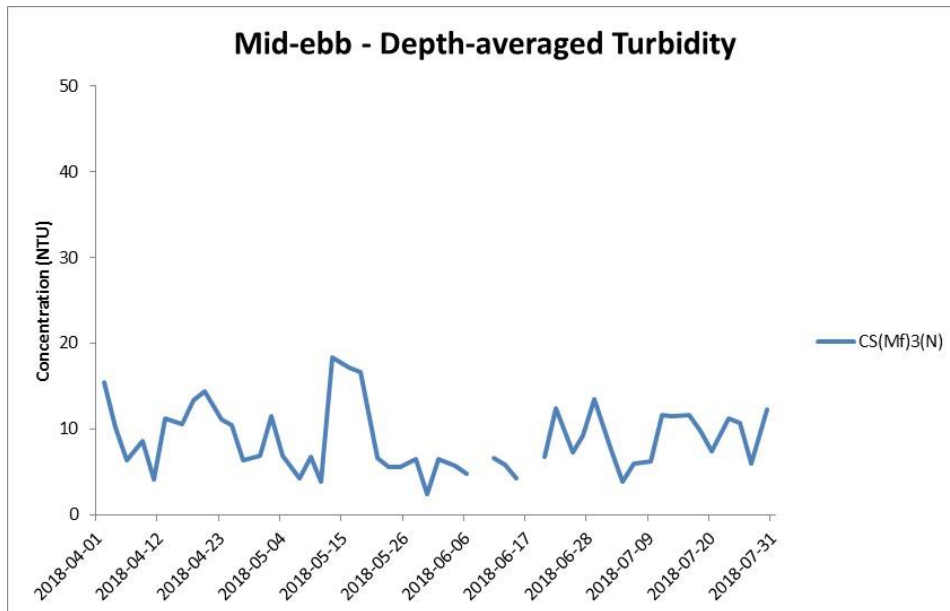


**Figure J21 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-ebb tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



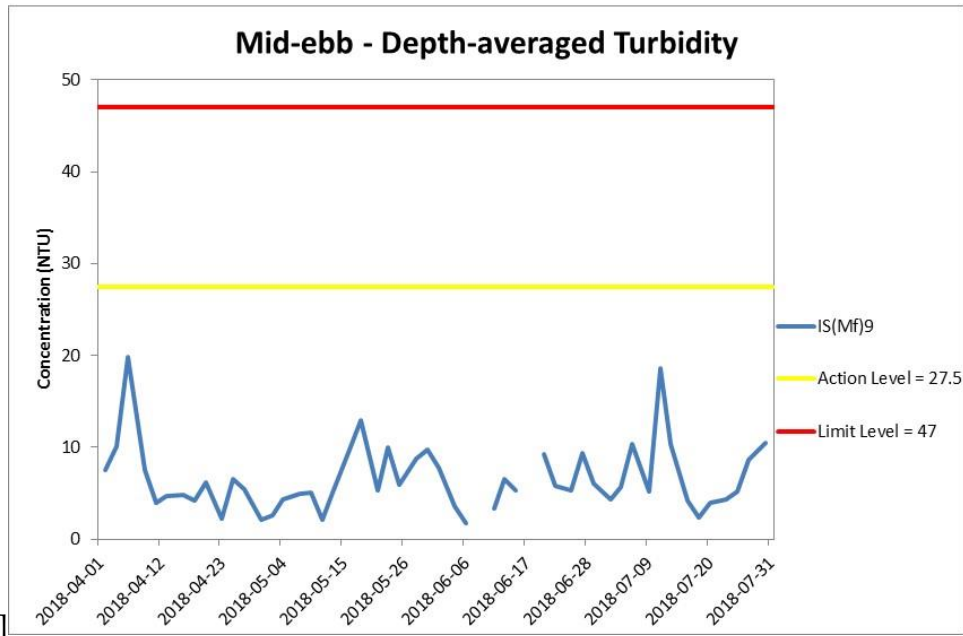
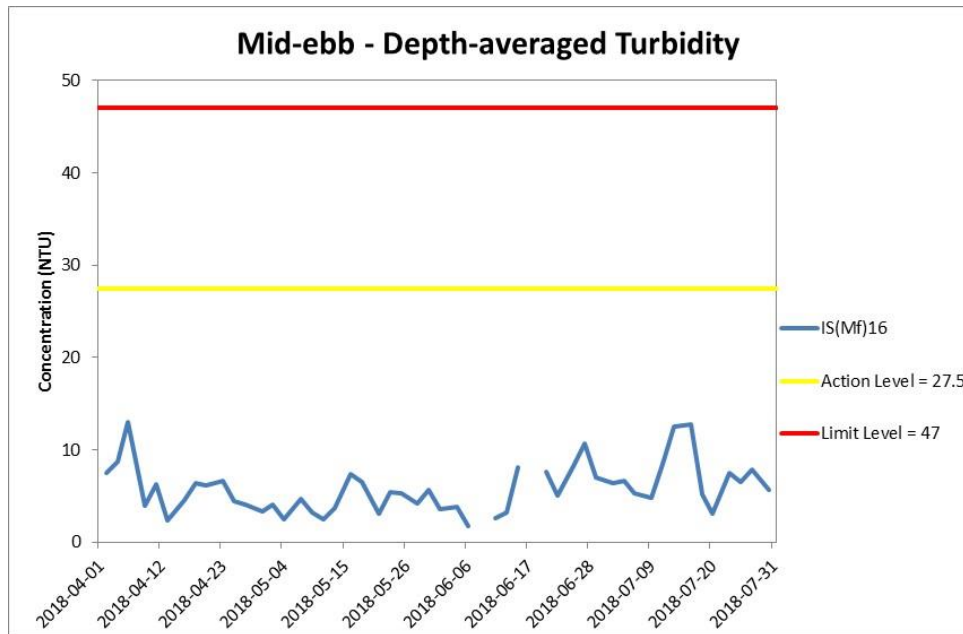


**Figure J22 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-ebb tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



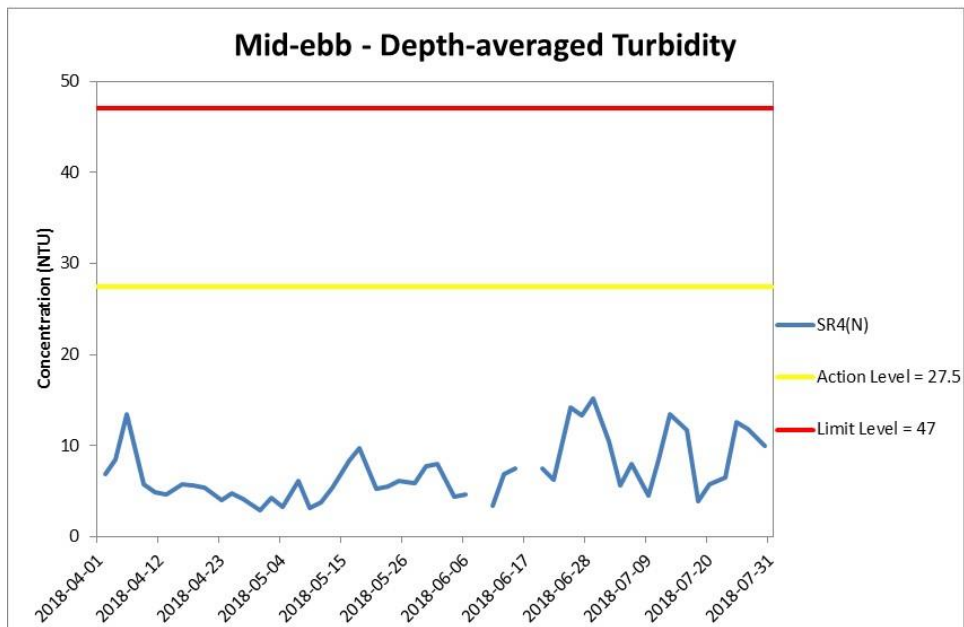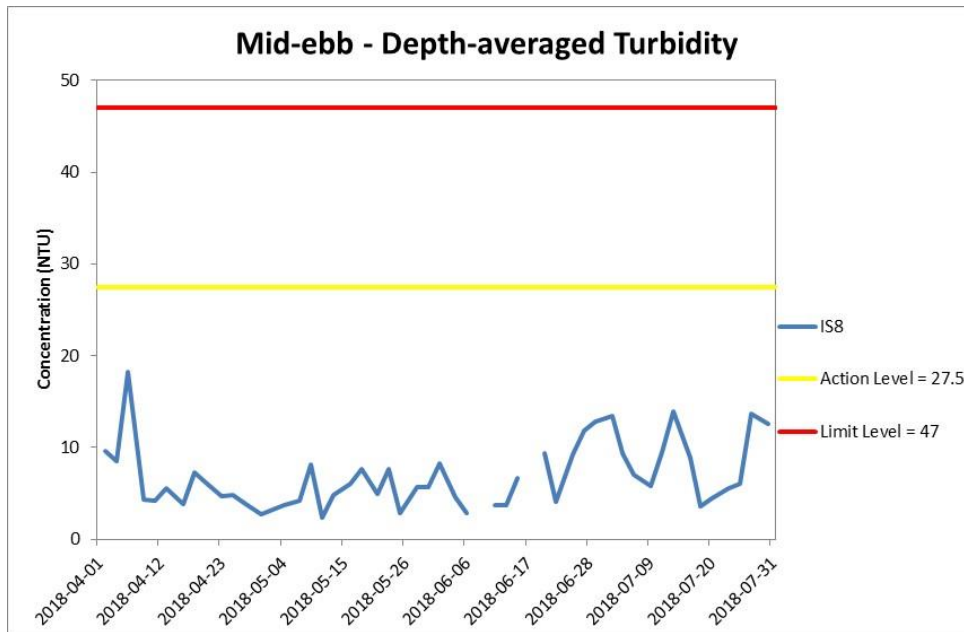


**Figure J23 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-ebb tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**






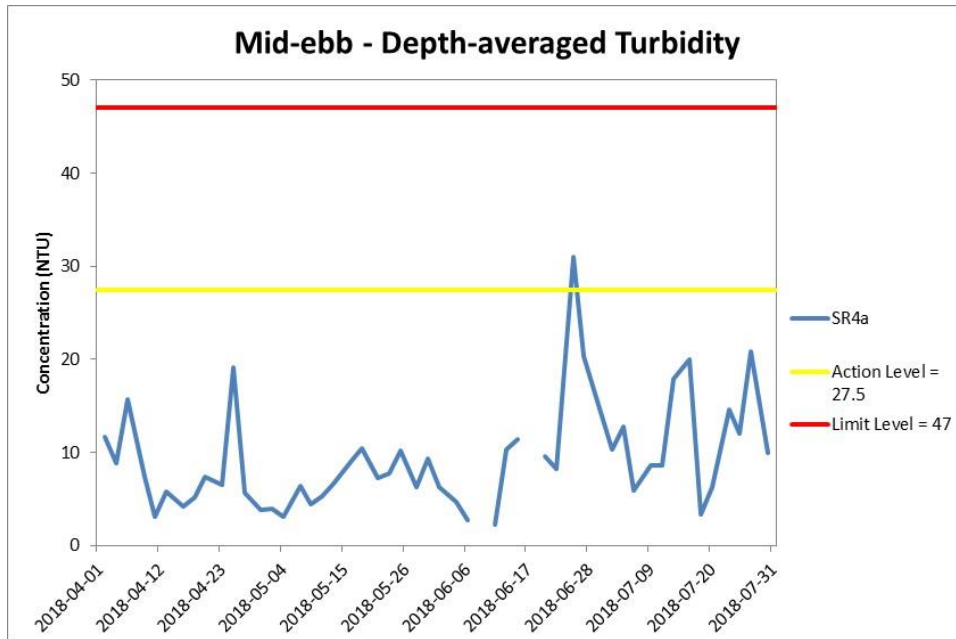


**Figure J24 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-ebb tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



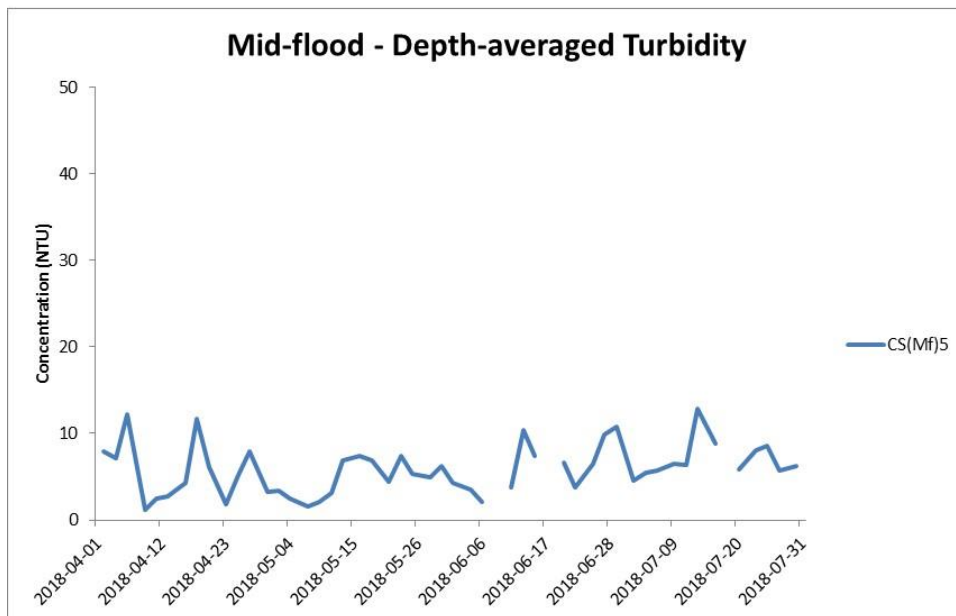
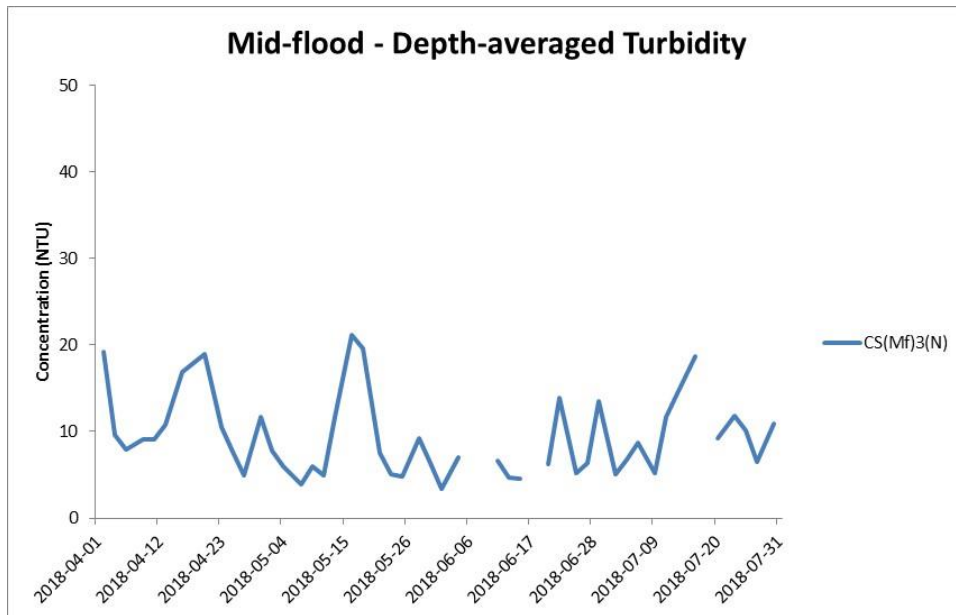


**Figure J25 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-flood tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



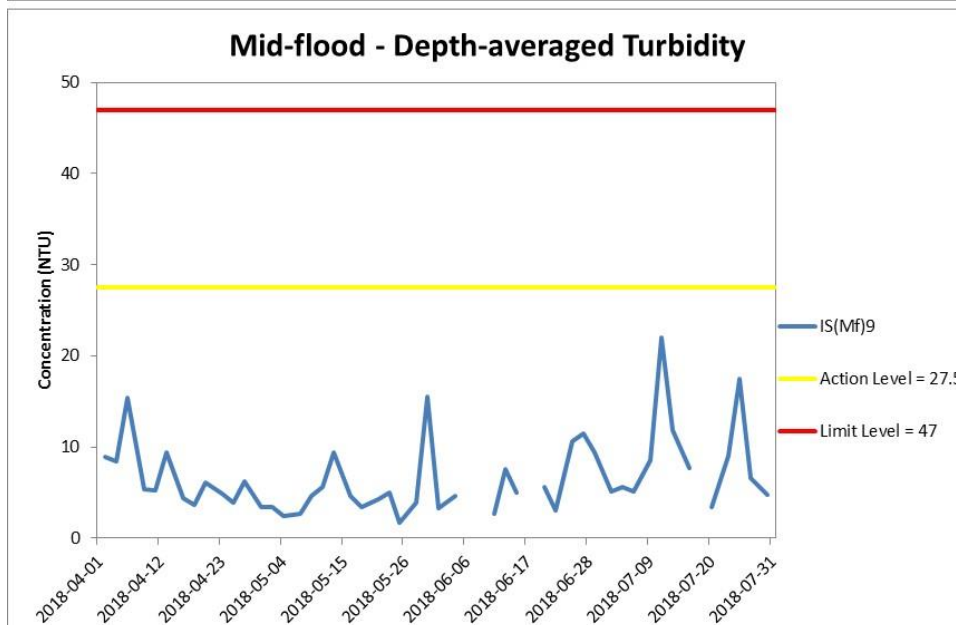
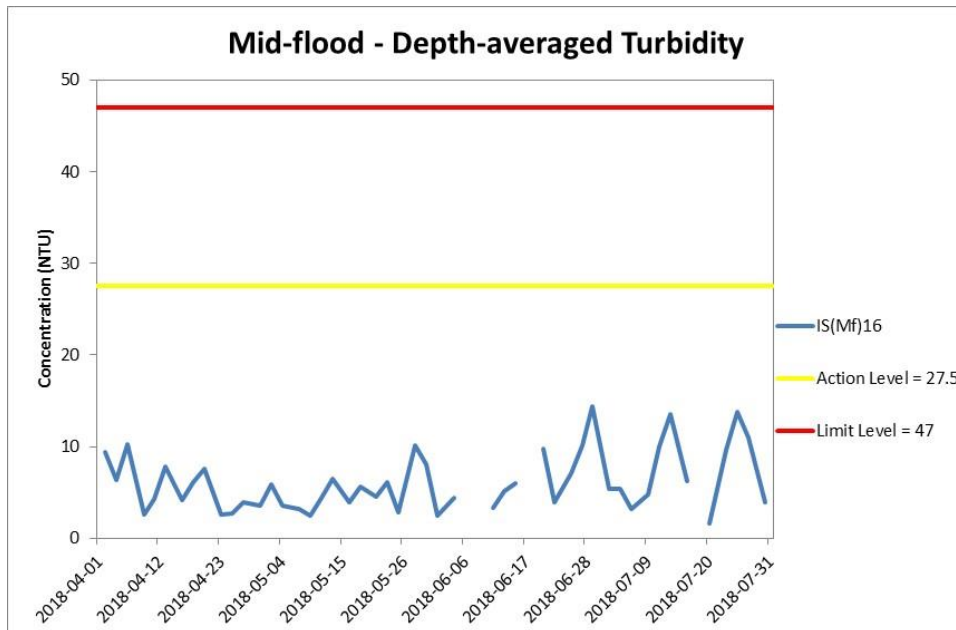


**Figure J26 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-flood tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



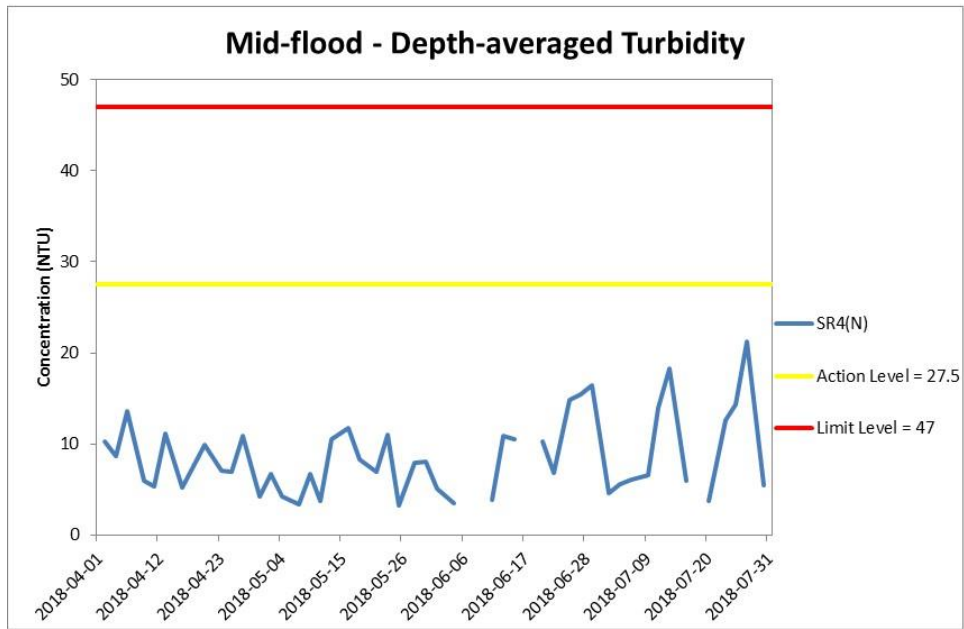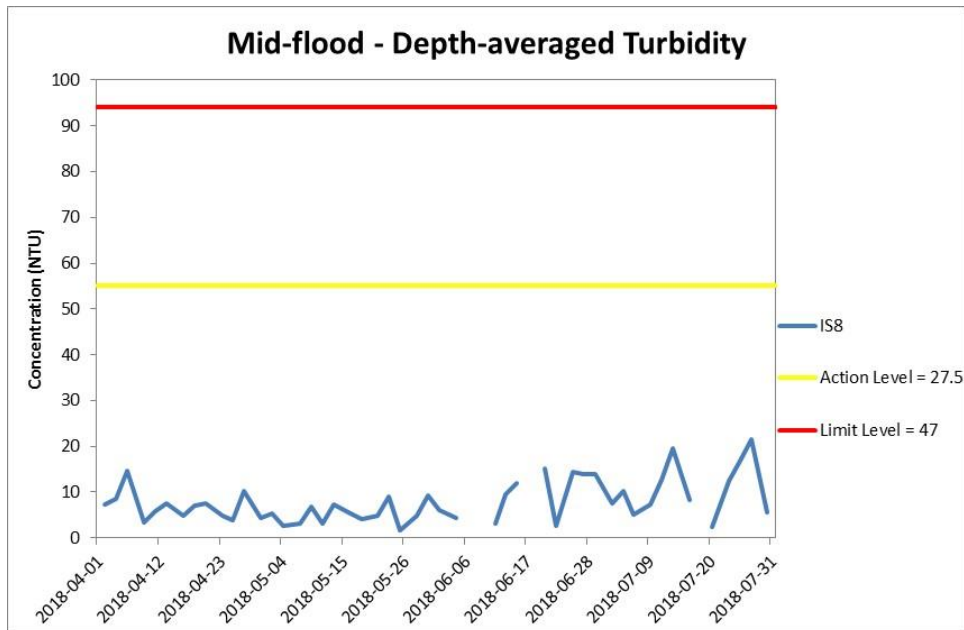


**Figure J27 Impact Monitoring – Mean Level of depth-averaged Turbidity (NTU) during mid-flood tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**




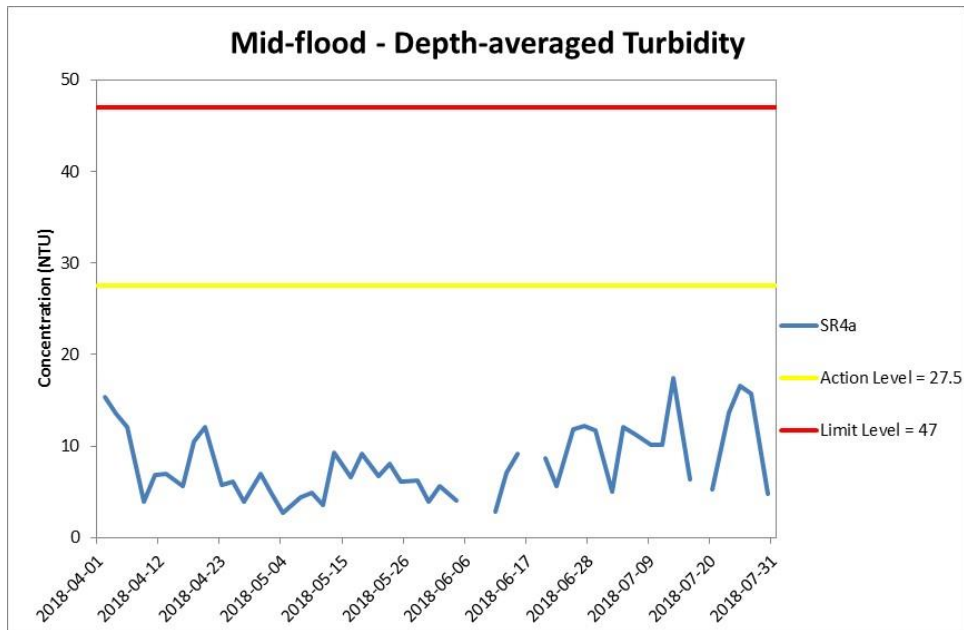


**Figure J28 Impact Monitoring - Mean Level of depth-averaged Turbidity (NTU) during mid-flood tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



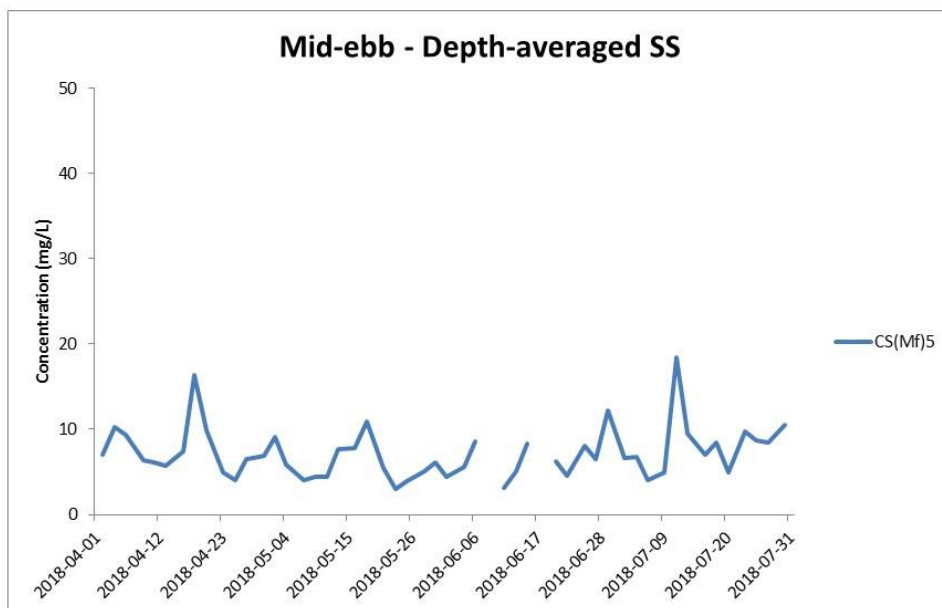
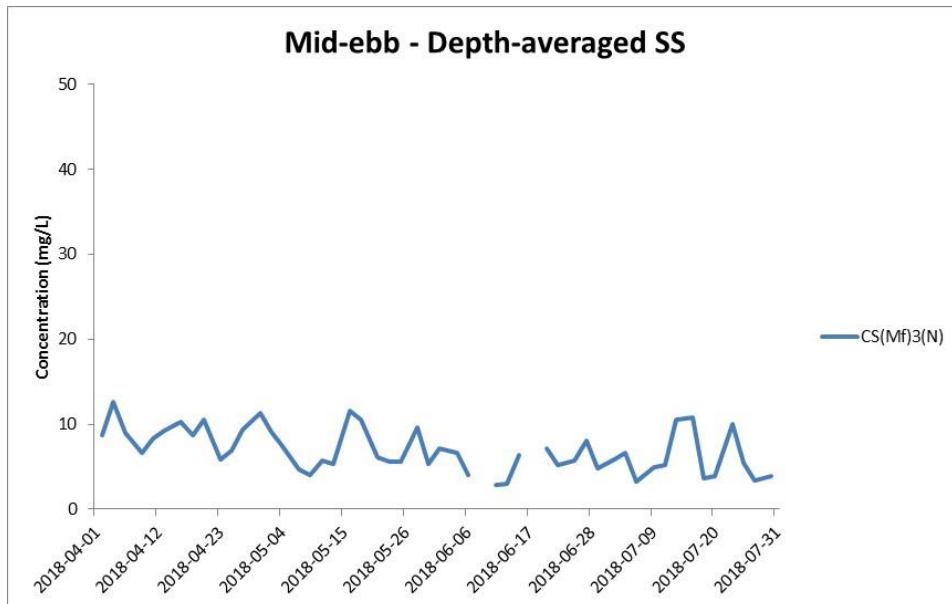


**Figure J29 Impact Monitoring - Mean depth-averaged level of Suspended Solids (mg/L) during mid-ebb tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



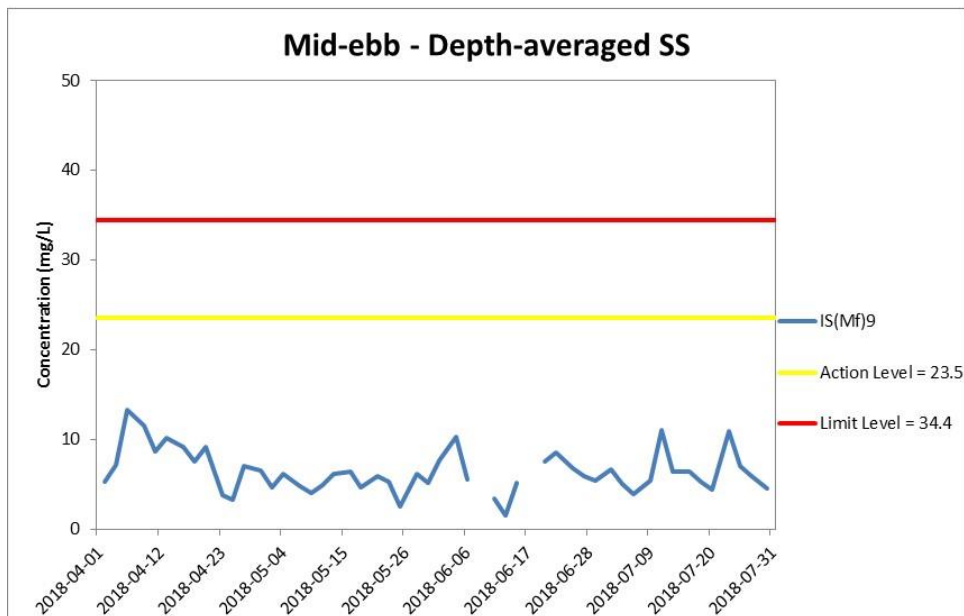
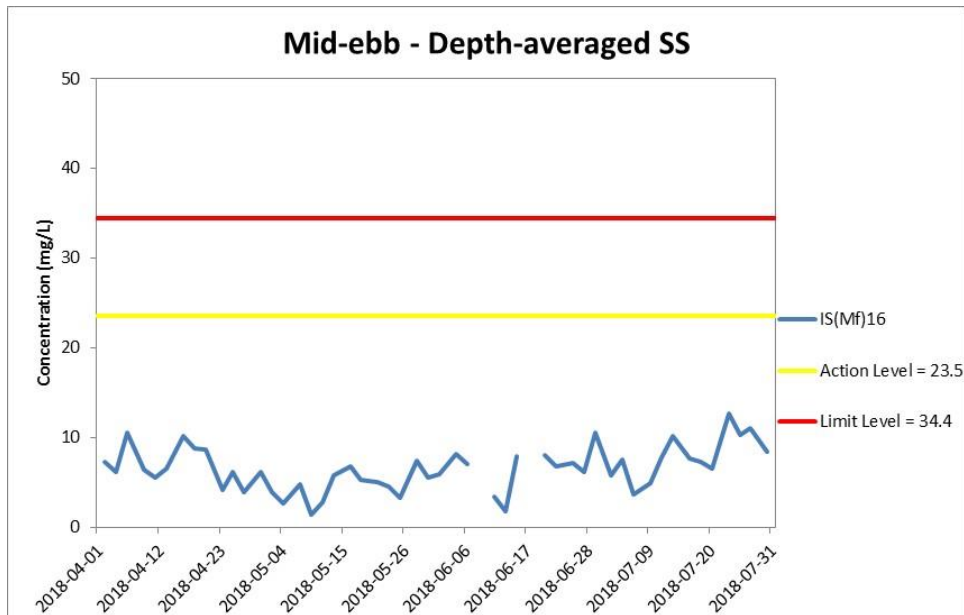


**Figure J30 Impact Monitoring - Mean depth-averaged level of Suspended Solids (mg/L) during mid-ebb tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



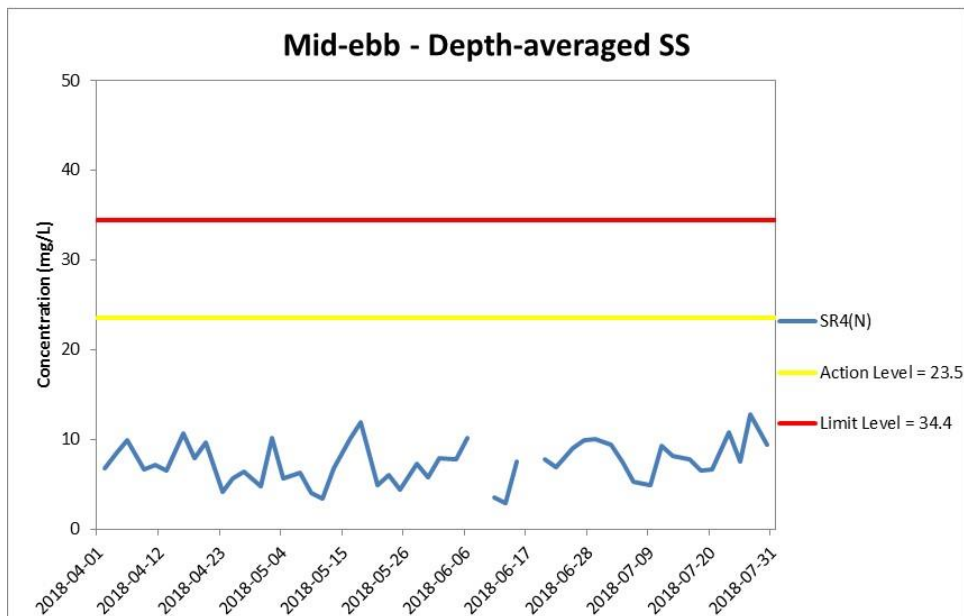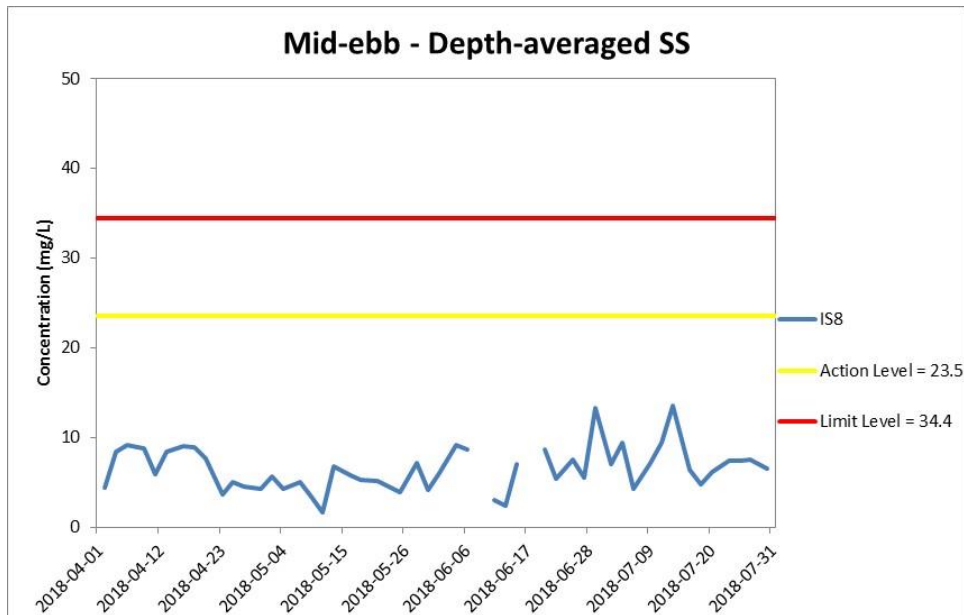


**Figure J31 Impact Monitoring - Mean depth-averaged level of Suspended Solids (mg/L) during mid-ebb tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**






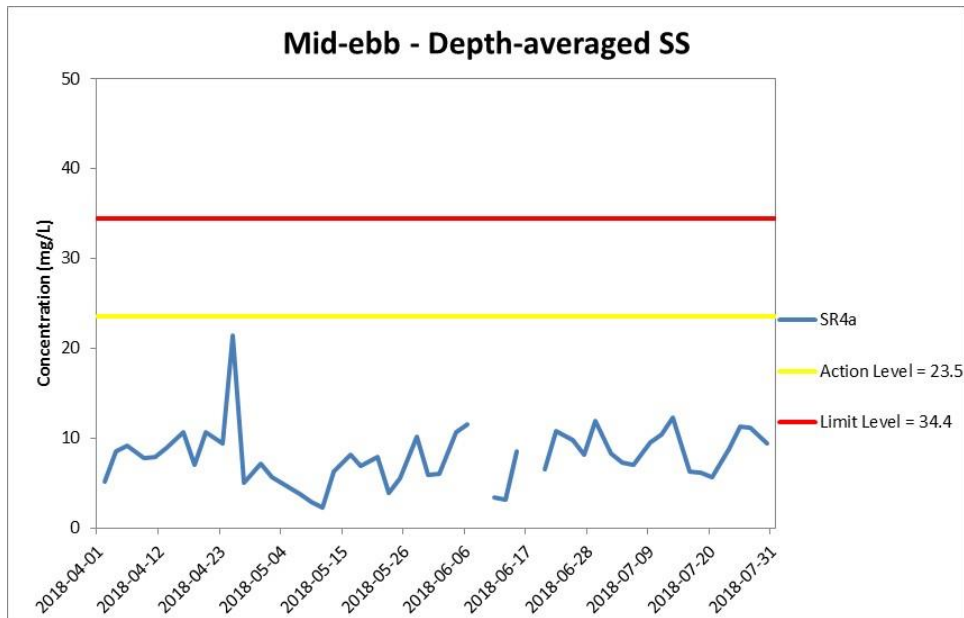


**Figure J32 Impact Monitoring – Mean depth-averaged level of Suspended Solids (mg/L) during mid-ebb tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



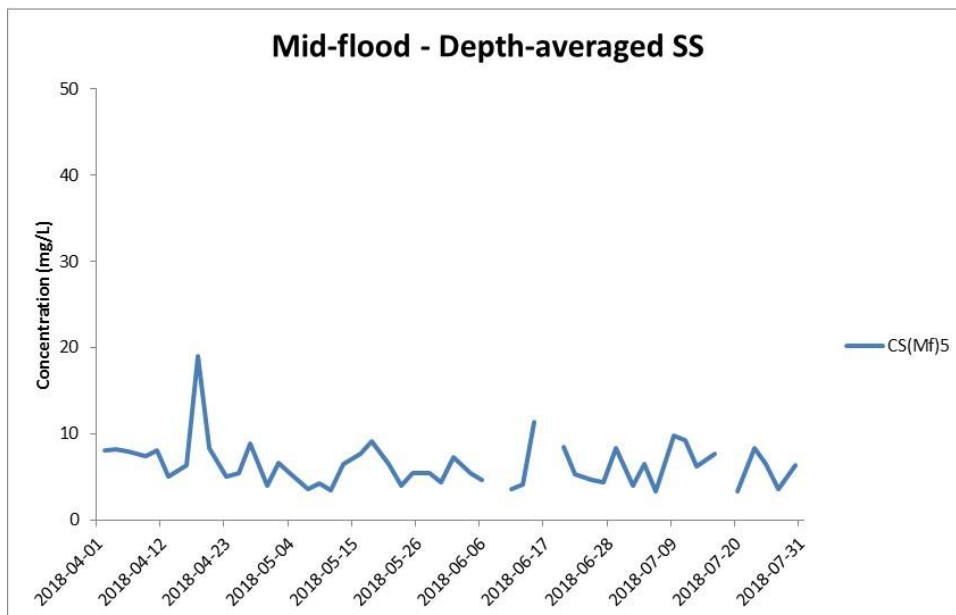
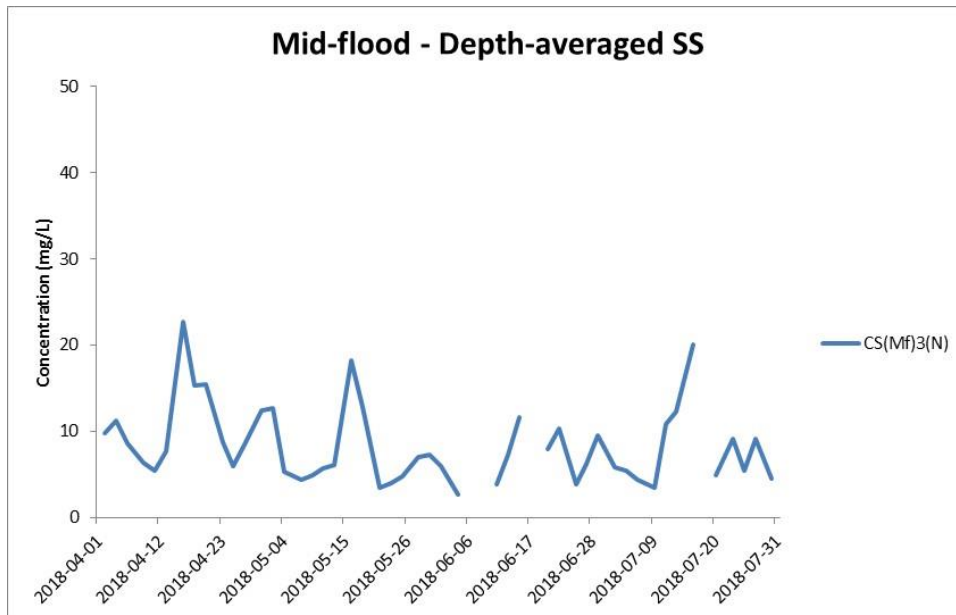


**Figure J33 Impact Monitoring - Mean depth-averaged level of Suspended Solids (mg/L) during mid-flood tide between 1 April and 31 July 2018 at CS(Mf)3(N) and CS(Mf)5.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



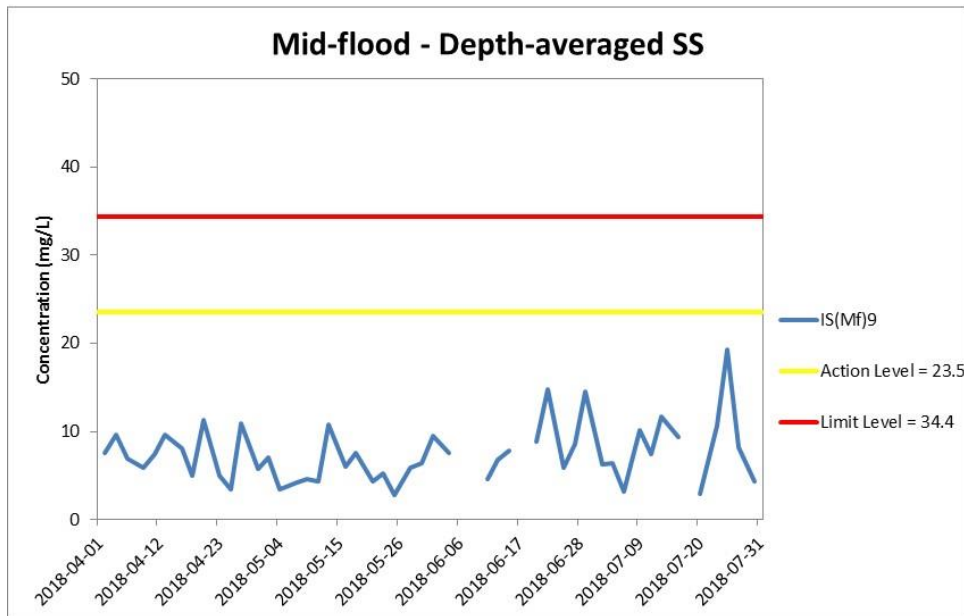
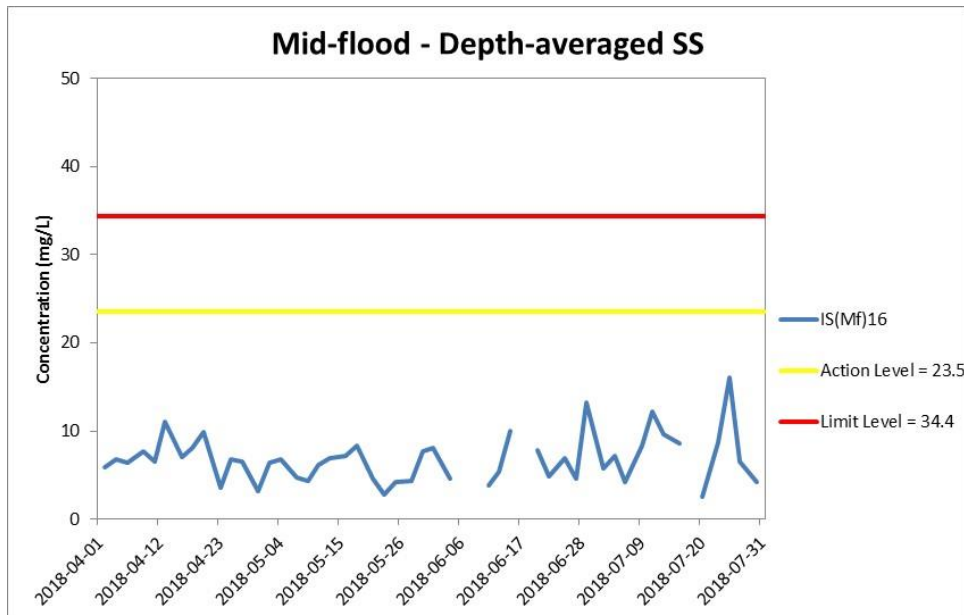


**Figure J34 Impact Monitoring - Mean depth-averaged level of Suspended Solids (mg/L) during mid-flood tide between 1 April and 31 July 2018 at IS(Mf)16 and IS(Mf)9.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



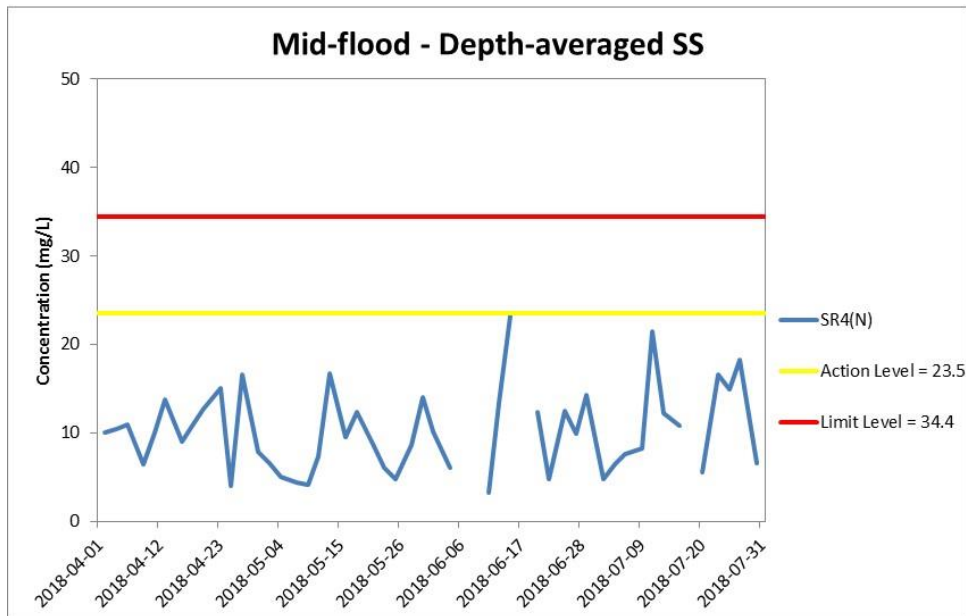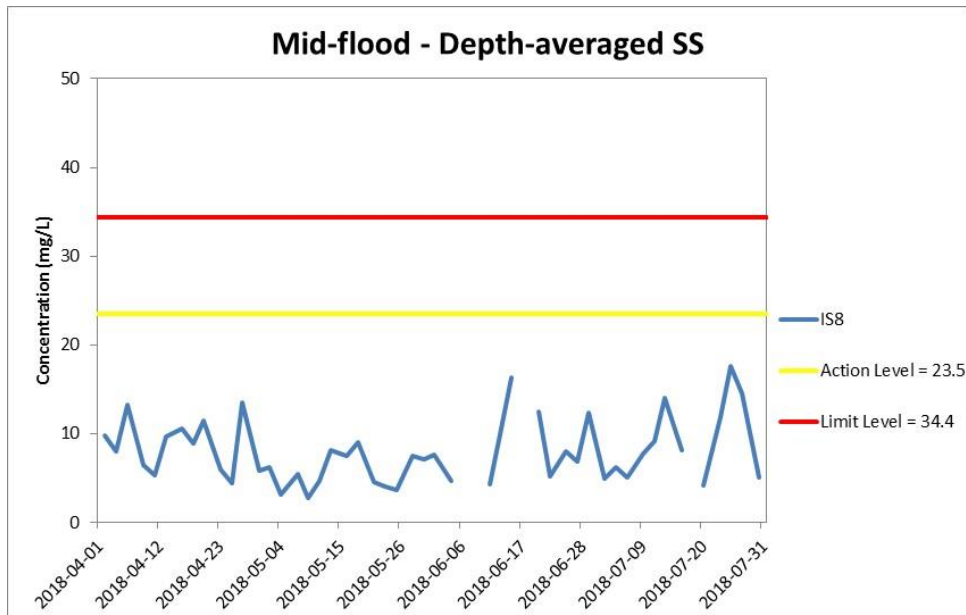


**Figure J35 Impact Monitoring - Mean depth-averaged level of Suspended Solids (mg/L) during mid-flood tide between 1 April and 31 July 2018 at IS8 and SR4(N).**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
Resources  
Management**



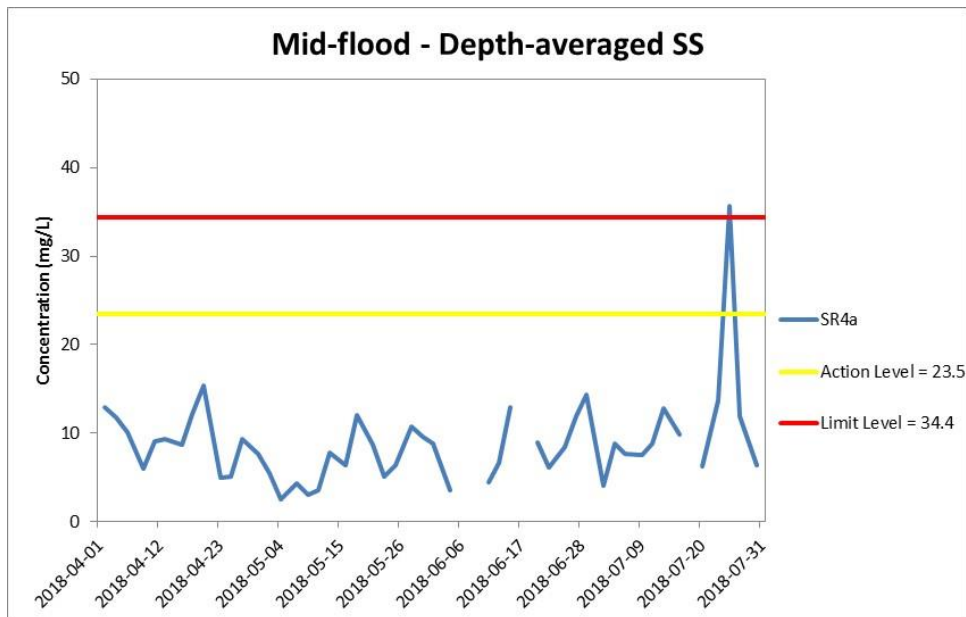

**Figure J36 Impact Monitoring – Mean depth-averaged level of Suspended Solids (mg/L) during mid-flood tide between 1 April and 31 July 2018 at SR4a.**

*(Weather condition varied between sunny to rainy within the reporting period.)*  
 WQM during mid-flood at all water quality monitoring stations on 18 July 2018 was canceled due to adverse weather. In-situ monitoring is taken according to the requirement specified in the EM&A Manual, i.e. 3 water depth namely 1m below sea surface, mid-depth and 1m above sea bed. If the water depth is less than 3m, mid-depth sampling only. If water depth less than 6m, mid-depth may be omitted.

**Environmental  
 Resources  
 Management**



Appendix K

## Impact Dolphin Monitoring Survey Results

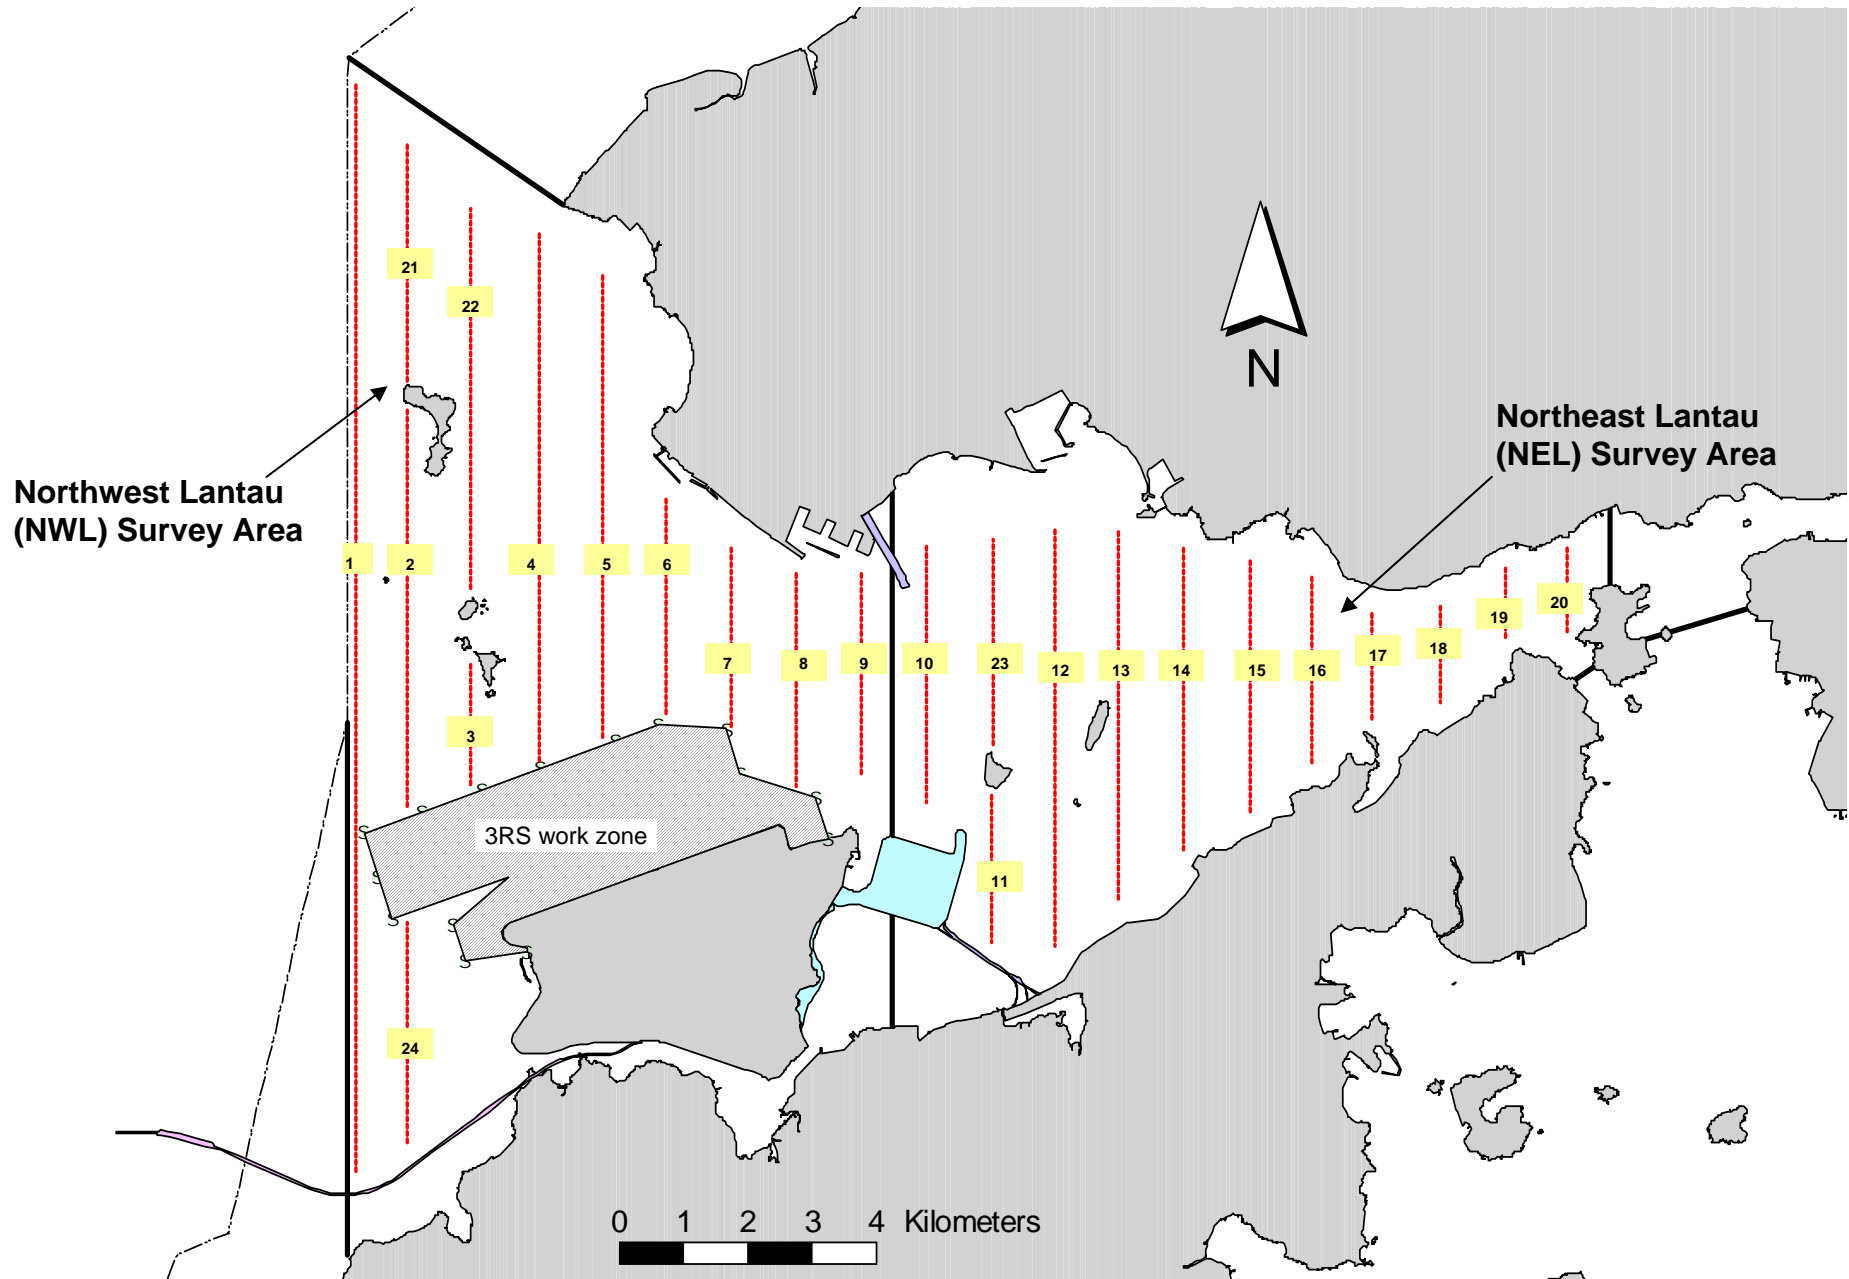


Figure 1. Transect Line Layout in Northwest and Northeast Lantau Survey Areas

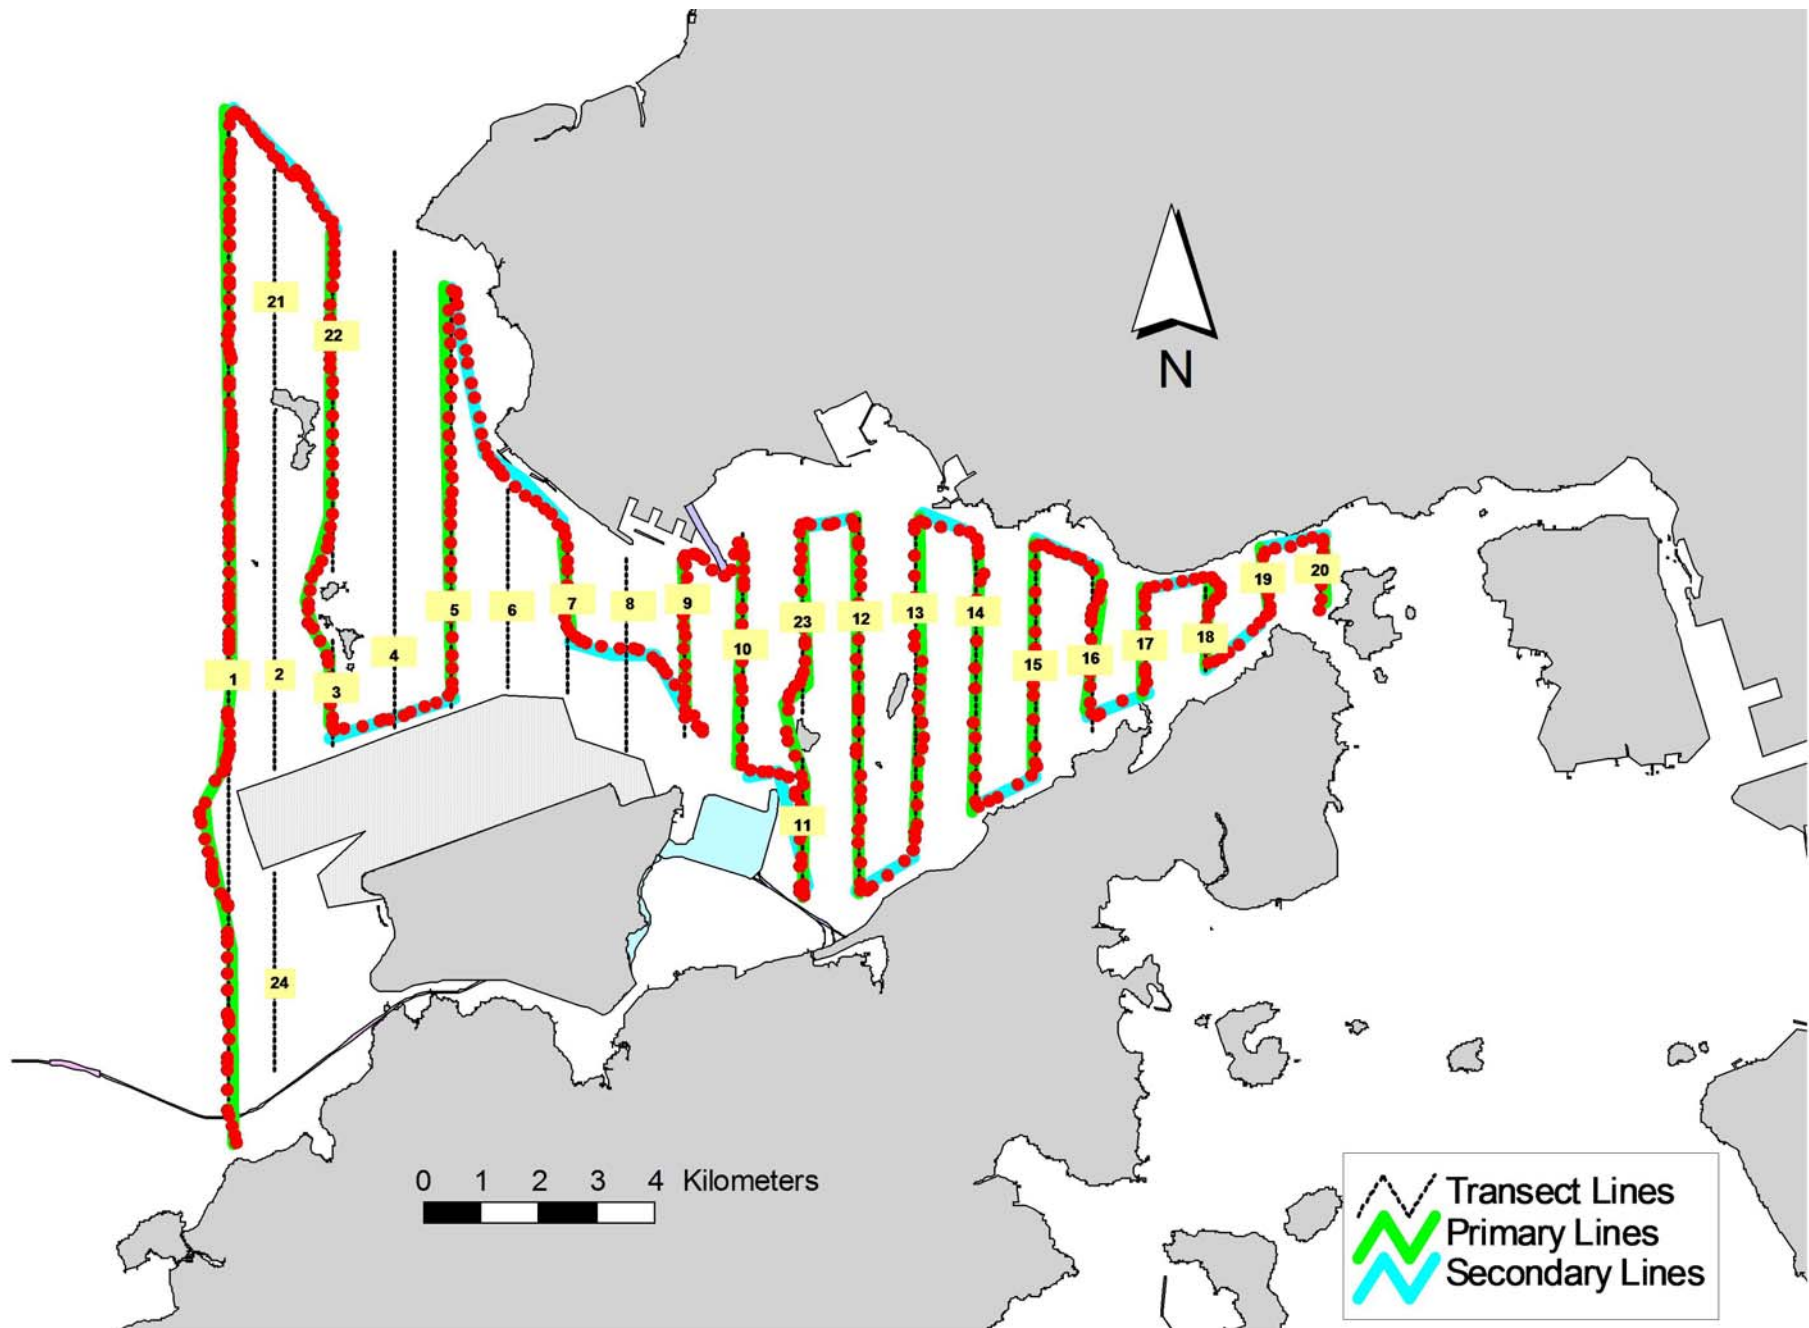


Figure 2. Survey Route on July 3rd, 2018 (from HKLR03 project)





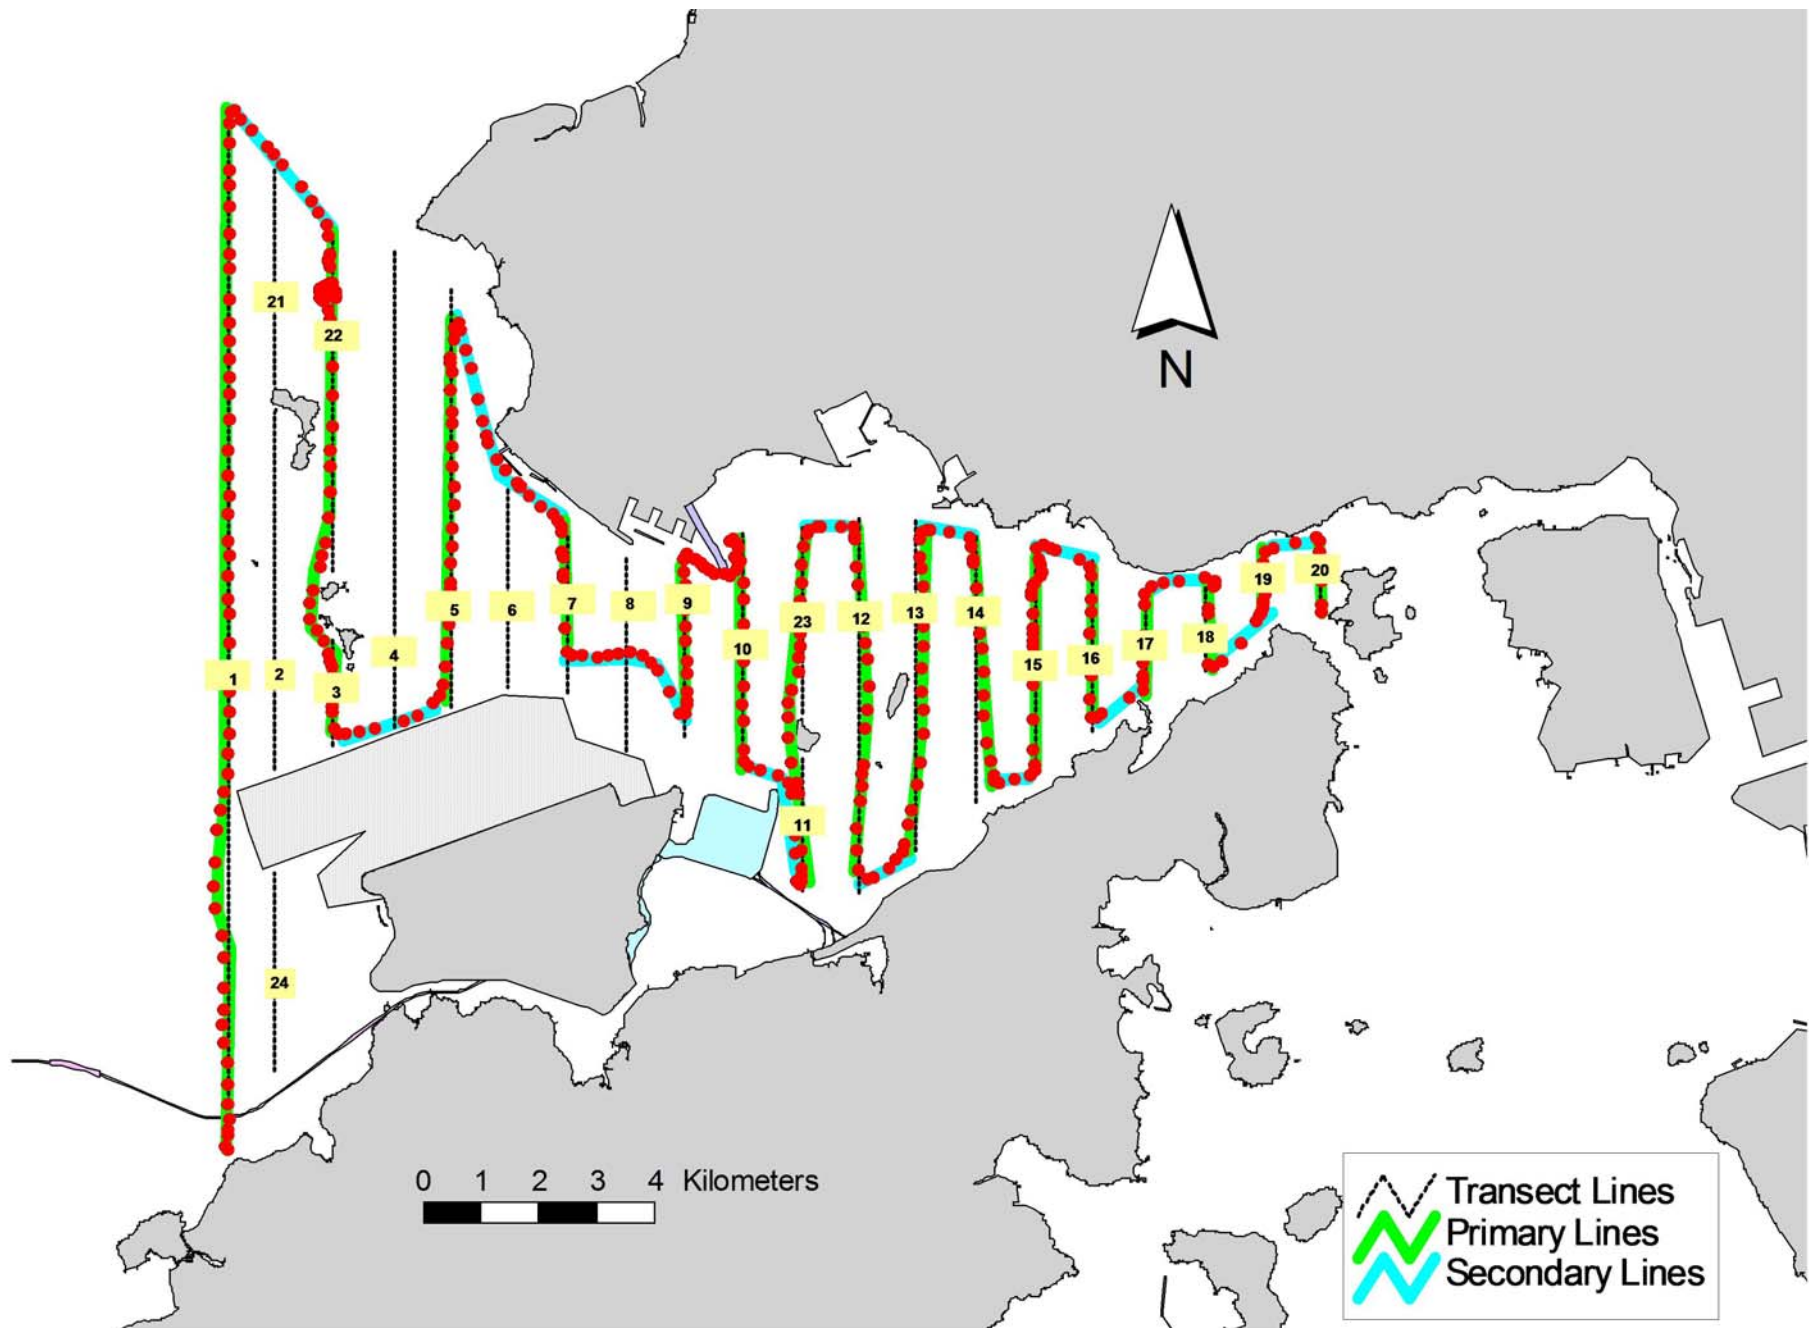


Figure 4. Survey Route on July 12<sup>th</sup>, 2018 (from HKLR03 project)



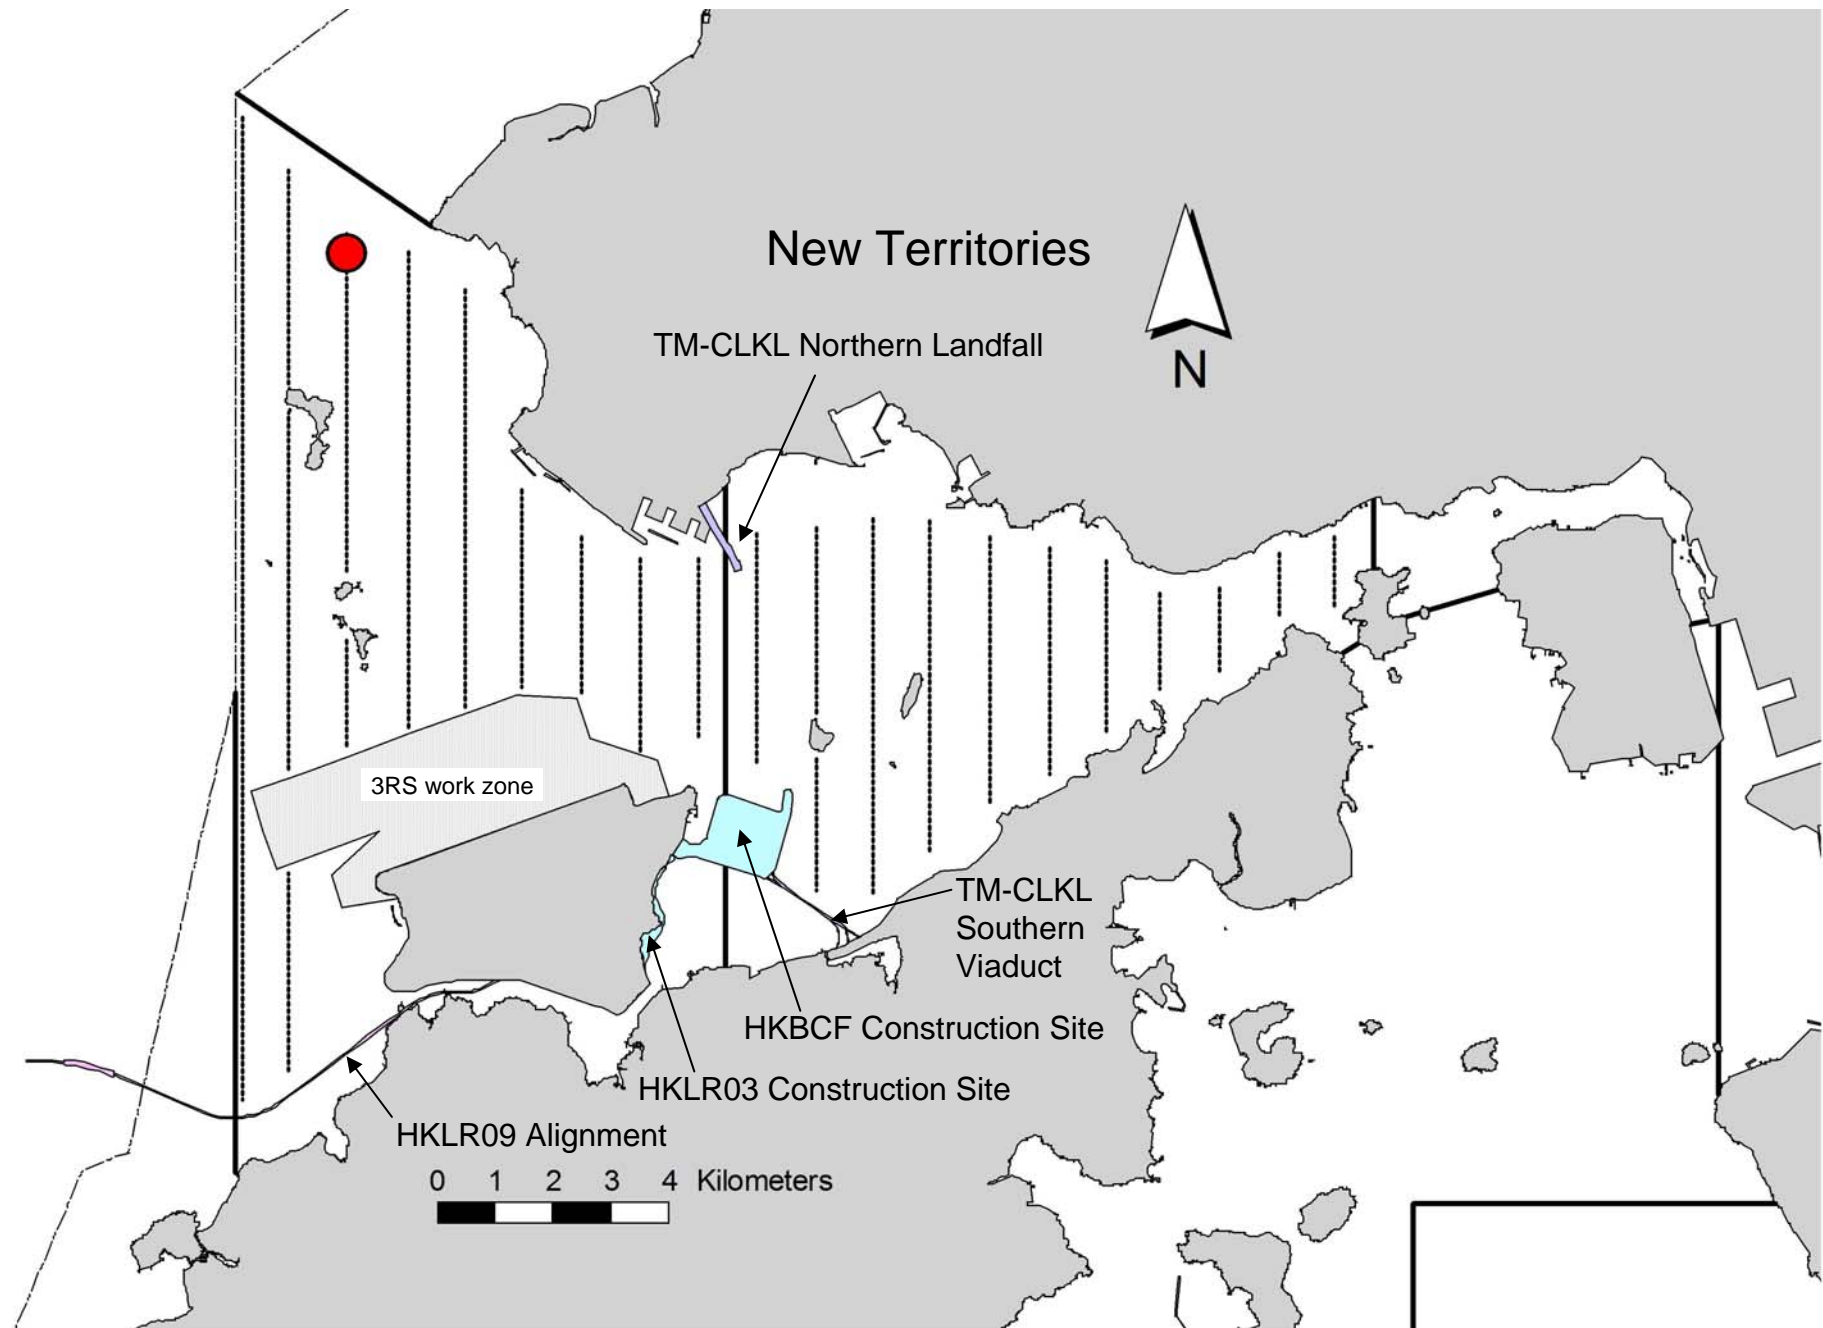


Figure 6. Distribution of Chinese White Dolphin Sightings during July 2018 HKLR03 Monitoring Surveys

## Appendix I. HKLR03 Survey Effort Database (July 2018)

(Abbreviations: BEAU = Beaufort Sea State; P = Primary Line Effort; S = Secondary Line Effort)

DATE	AREA	BEAU	EFFORT	SEASON	VESSEL	TYPE	P/S
3-Jul-18	NW LANTAU	3	24.91	SUMMER	STANDARD36826	HKLR	P
3-Jul-18	NW LANTAU	4	10.69	SUMMER	STANDARD36826	HKLR	P
3-Jul-18	NW LANTAU	3	12.89	SUMMER	STANDARD36826	HKLR	S
3-Jul-18	NW LANTAU	4	0.81	SUMMER	STANDARD36826	HKLR	S
3-Jul-18	NE LANTAU	2	28.85	SUMMER	STANDARD36826	HKLR	P
3-Jul-18	NE LANTAU	3	7.29	SUMMER	STANDARD36826	HKLR	P
3-Jul-18	NE LANTAU	2	13.36	SUMMER	STANDARD36826	HKLR	S
3-Jul-18	NE LANTAU	3	0.80	SUMMER	STANDARD36826	HKLR	S
9-Jul-18	NW LANTAU	2	4.62	SUMMER	STANDARD36826	HKLR	P
9-Jul-18	NW LANTAU	3	17.99	SUMMER	STANDARD36826	HKLR	P
9-Jul-18	NW LANTAU	4	0.98	SUMMER	STANDARD36826	HKLR	P
9-Jul-18	NW LANTAU	2	0.90	SUMMER	STANDARD36826	HKLR	S
9-Jul-18	NW LANTAU	3	7.21	SUMMER	STANDARD36826	HKLR	S
12-Jul-18	NW LANTAU	2	19.42	SUMMER	STANDARD36826	HKLR	P
12-Jul-18	NW LANTAU	3	15.11	SUMMER	STANDARD36826	HKLR	P
12-Jul-18	NW LANTAU	2	3.70	SUMMER	STANDARD36826	HKLR	S
12-Jul-18	NW LANTAU	3	7.80	SUMMER	STANDARD36826	HKLR	S
12-Jul-18	NW LANTAU	4	1.30	SUMMER	STANDARD36826	HKLR	S
12-Jul-18	NE LANTAU	2	15.65	SUMMER	STANDARD36826	HKLR	P
12-Jul-18	NE LANTAU	3	18.42	SUMMER	STANDARD36826	HKLR	P
12-Jul-18	NE LANTAU	2	10.66	SUMMER	STANDARD36826	HKLR	S
12-Jul-18	NE LANTAU	3	2.77	SUMMER	STANDARD36826	HKLR	S
20-Jul-18	NW LANTAU	1	1.50	SUMMER	STANDARD36826	HKLR	P
20-Jul-18	NW LANTAU	2	18.66	SUMMER	STANDARD36826	HKLR	P
20-Jul-18	NW LANTAU	3	4.88	SUMMER	STANDARD36826	HKLR	P
20-Jul-18	NW LANTAU	1	0.90	SUMMER	STANDARD36826	HKLR	S
20-Jul-18	NW LANTAU	2	2.82	SUMMER	STANDARD36826	HKLR	S
20-Jul-18	NW LANTAU	3	4.14	SUMMER	STANDARD36826	HKLR	S

**Appendix II. HKLR03 Chinese White Dolphin Sighting Database July 2018)**

(Abberviations: STG# = Sighting Number; HRD SZ = Dolphin Herd Size; BEAU = Beaufort Sea State; PSD = Perpendicular Distance;  
BOAT ASSOC. = Fishing Boat Association; P/S: Sighting Made on Primary/Secondary Line\$

DATE	STG #	TIME	HRD SZ	AREA	BEAU	PSD	EFFORT	TYPE	NORTHING	EASTING	SEASON	BOAT ASSOC.	P/S
12-Jul-18	1	1125	4	NW LANTAU	3	156	ON	HKLR	829186	806430	SUMMER	NONE	P

**Appendix III. Individual dolphins identified during HKLR03 monitoring surveys in July 2018**

<b>ID#</b>	<b>DATE</b>	<b>STG#</b>	<b>AREA</b>
NL233	12/07/18	1	NW LANTAU
NL305	12/07/18	1	NW LANTAU
NL317	12/07/18	1	NW LANTAU
NL329	12/07/18	1	NW LANTAU



Appendix IV. Photographs of Identified Individual Dolphins in July 2018 (HKLR03)



Appendix L

## Event Action Plan

*Appendix L1 Event/ Action Plan for Air Quality*

EVENT	ET <sup>(1)</sup>	ACTION		
		IEC <sup>(1)</sup>	SOR <sup>(1)</sup>	Contractor
<b>Action Level</b>				
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify the source.</li> <li>2. Inform the IEC and the SOR.</li> <li>3. Repeat measurement to confirm finding.</li> <li>4. Increase monitoring frequency to daily.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET.</li> <li>2. Check Contractor's working method.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>1. Rectify any unacceptable practice</li> <li>2. Amend working methods if appropriate</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Identify the source.</li> <li>2. Inform the IEC and the SOR.</li> <li>3. Repeat measurements to confirm findings.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Discuss with the IEC and the Contractor on remedial actions required.</li> <li>6. If exceedance continues, arrange meeting with the IEC and the SOR.</li> <li>7. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET.</li> <li>2. Check the Contractor's working method.</li> <li>3. Discuss with the ET and the Contractor on possible remedial measures.</li> <li>4. Advise the SOR on the effectiveness of the proposed remedial measures.</li> <li>5. Supervisor implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit proposals for remedial actions to IEC within 3 working days of notification</li> <li>2. Implement the agreed proposals</li> <li>3. Amend proposal if appropriate</li> </ol>

EVENT	ET <sup>(1)</sup>	ACTION		
		IEC <sup>(1)</sup>	SOR <sup>(1)</sup>	Contractor
<b>Limit Level</b>				
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>1. Identify the source.</li> <li>2. Inform the SOR and the DEP.</li> <li>3. Repeat measurement to confirm finding.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep the IEC, the DEP and the SOR informed of the results.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by the ET.</li> <li>2. Check Contractor's working method.</li> <li>3. Discuss with the ET and the Contractor on possible remedial measures.</li> <li>4. Advise the SOR on the effectiveness of the proposed remedial measures.</li> <li>5. Supervisor implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Amend proposal if appropriate</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>1. Notify the IEC, the SOR, the DEP and the Contractor.</li> <li>2. Identify the source.</li> <li>3. Repeat measurements to confirm findings.</li> <li>4. Increase monitoring frequency to daily.</li> <li>5. Carry out analysis of the Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Arrange meeting with the IEC and the SOR to discuss the remedial actions to be taken.</li> <li>7. Assess effectiveness of the Contractor's remedial actions</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst the SOR, ET and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SOR accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedance continues, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Resubmit proposals if problem still not under control.</li> <li>5. Stop the relevant activity of works as determined by the SOR until the exceedance is abated.</li> </ol>

---

and keep the IEC, the DEP and  
the SOR informed of the results.

8. If the exceedance stops, cease  
additional monitoring.

---

*Appendix L2 Event/ Action Plan for Construction Noise*

ACTION					
EVENT	ET	IEC	SOR	Contractor	
Action Level	<ol style="list-style-type: none"> <li>1. Notify the IEC and the Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to the IEC and the Contractor.</li> <li>4. Discuss with the Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise the SOR accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC</li> <li>2. Implement noise mitigation proposals</li> </ol>	
Limit Level	<ol style="list-style-type: none"> <li>1. Notify the IEC, the SOR, the DEP and the Contractor.</li> <li>2. Identify the source.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform the IEC, the SOR and the DEP the causes &amp; actions taken for the exceedances.</li> <li>7. Assess effectiveness of the Contractor's remedial actions and keep the IEC, the DEP and the SOR informed of the results.</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst the SOR, the ET and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise the SOR accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedance continues, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification</li> <li>3. Implement the agreed proposals</li> <li>4. Resubmit proposals if problem still not under control</li> <li>5. Stop the relevant activity of works as determined by the SOR until the exceedance is abated.</li> </ol>	

**Appendix L3**      *Event/ Action Plan for Water Quality*

<b>Event</b>	<b>ET Leader</b>	<b>IEC</b>	<b>SOR</b>	<b>Contractor</b>
Action level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>Repeat in situ measurement on next day of exceedance to confirm findings;</li> <li>Identify source(s) of impact;</li> <li>Inform IEC, contractor and SOR;</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET and Contractor's working methods.</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of non-compliance in writing;</li> <li>Notify Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>Inform the SOR and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>
Action level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> <li>Repeat measurement on next day of exceedance to confirm findings;</li> <li>Identify source(s) of impact;</li> <li>Inform IEC, contractor, SOR and EPD;</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Discuss mitigation measures with IEC, SOR and Contractor;</li> <li>Ensure mitigation measures are implemented;</li> <li>Increase the monitoring frequency to daily until no exceedance of Action level;</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET and Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial actions;</li> <li>Review the proposed mitigation measures submitted by Contractor and advise the SOR accordingly;</li> <li>Supervise the implementation of mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>Discuss with IEC on the proposed mitigation measures;</li> <li>Ensure mitigation measures are properly implemented;</li> <li>Assess the effectiveness of the implemented mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>Inform the Supervising Officer and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment and consider changes of working methods;</li> <li>Submit proposal of additional mitigation measures to SOR within 3 working days of notification and discuss with ET, IEC and SOR;</li> <li>Implement the agreed mitigation measures.</li> </ol>
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>Repeat measurement on next day of exceedance to confirm findings;</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET and Contractor's working method;</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of failure in writing;</li> </ol>	<ol style="list-style-type: none"> <li>Inform the SOR and confirm notification of the non-compliance in writing;</li> </ol>

Event	ET Leader	IEC	SOR	Contractor
	2. Identify source(s) of impact;		2. Discuss with IEC, ET and Contractor on the proposed mitigation measures;	2. Rectify unacceptable practice;
	3. Inform IEC, contractor, SOR and EPD;	2. Discuss with ET and Contractor on possible remedial actions;		3. Check all plant and equipment and consider changes of working methods;
	4. Check monitoring data, all plant, equipment and Contractor's working methods;	3. Review the proposed mitigation measures submitted by Contractor and advise the SOR accordingly.	3. Request Contractor to review the working methods.	4. Submit proposal of mitigation measures to SOR within 3 working days of notification and discuss with ET, IEC and SOR.
	5. Discuss mitigation measures with IEC, SOR and Contractor;			
Limit level being exceeded by two or more consecutive sampling days	1. Repeat measurement on next day of exceedance to confirm findings;	1. Check monitoring data submitted by ET and Contractor's working method;	1. Discuss with IEC, ET and Contractor on the proposed mitigation measures;	1. Take immediate action to avoid further exceedance;
	2. Identify source(s) of impact;	2. Discuss with ET and Contractor on possible remedial actions;	2. Request Contractor to critically review the working methods;	2. Submit proposal of mitigation measures to SOR within 3 working days of notification and discuss with ET, IEC and SOR;
	3. Inform IEC, contractor, SOR and EPD;	3. Review the Contractor's mitigation measures whenever necessary to assure their effectiveness and advise the SOR accordingly;	3. Make agreement on the mitigation measures to be implemented;	3. Implement the agreed mitigation measures;
	4. Check monitoring data, all plant, equipment and Contractor's working methods;	4. Supervise the implementation of mitigation measures.	4.	4. Resubmit proposals of mitigation measures if problem still not under control;
	5. Discuss mitigation measures with IEC, SOR and Contractor;		5. Ensure mitigation measures are properly implemented;	
	6. Ensure mitigation measures are implemented;		6.	
	7. Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days;		7. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level.	5. As directed by the Supervising Officer, to slow down or to stop all or part of the construction activities until no exceedance of Limit level.

**Appendix L4 Implementation of Event-Action Plan for Dolphin Monitoring**

<b>Event</b>	<b>ET Leader</b>	<b>IEC</b>	<b>SOR</b>	<b>Contractor</b>
Action Level	<ol style="list-style-type: none"> <li>1. Repeat statistical data analysis to confirm findings;</li> <li>2. Review all available and relevant data, including raw data and statistical analysis results of other parameters covered in the EM&amp;A, to ascertain if differences are as a result of natural variation or previously observed seasonal differences;</li> <li>3. Identify source(s) of impact;</li> <li>4. Inform the IEC, SOR and Contractor;</li> <li>5. Check monitoring data.</li> <li>6. Review to ensure all the dolphin protective measures are fully and properly implemented and advise on additional measures if necessary.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET and Contractor;</li> <li>2. Discuss monitoring results and findings with the ET and the Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss monitoring with the IEC and any other measures proposed by the ET;</li> <li>2. If SOR is satisfied with the proposal of any other measures, SOR to signify the agreement in writing on the measures to be implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the SOR and confirm notification of the non-compliance in writing;</li> <li>2. Discuss with the ET and the IEC and propose measures to the IEC and the SOR;</li> <li>3. Implement the agreed measures.</li> </ol>



<b>Event</b>	<b>ET Leader</b>	<b>IEC</b>	<b>SOR</b>	<b>Contractor</b>
Limit Level	<ol style="list-style-type: none"> <li>1. Repeat statistical data analysis to confirm findings;</li> <li>2. Review all available and relevant data, including raw data and statistical analysis results of other parameters covered in the EM&amp;A, to ascertain if differences are as a result of natural variation or previously observed seasonal differences;</li> <li>3. Identify source(s) of impact;</li> <li>4. Inform the IEC, ER/SOR and Contractor of findings;</li> <li>5. Check monitoring data;</li> <li>6. Repeat review to ensure all the dolphin protective measures are fully and properly implemented and advise on additional measures if necessary;</li> <li>7. If ET proves that the source of impact is caused by any of the construction activity by the works contract, ET to arrange a meeting to discuss with IEC, ER/SOR and Contractor the necessity of additional dolphin monitoring and/or any other potential mitigation measures (e.g., consider to modify the perimeter silt curtain or consider to control/temporarily stop relevant construction activity etc.) and submit to IEC a proposal of additional dolphin monitoring and/or mitigation measures where necessary.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET and Contractor;</li> <li>2. Discuss monitoring results and findings with the ET and the Contractor;</li> <li>3. Attend the meeting to discuss with ET, ER/SOR and Contractor the necessity of additional dolphin monitoring and any other potential mitigation measures;</li> <li>4. Review proposals for additional monitoring and any other mitigation measures submitted by ET and Contractor and advise ER/SOR of the results and findings accordingly;</li> <li>5. Supervise / Audit the implementation of additional monitoring and/or any other mitigation measures and advise ER/SOR the results and findings accordingly.</li> </ol>	<ol style="list-style-type: none"> <li>1. Attend the meeting to discuss with ET, IEC and Contractor the necessity of additional dolphin monitoring and any other potential mitigation measures;</li> <li>2. If ER/SOR is satisfied with the proposals for additional dolphin monitoring and/or any other mitigation measures submitted by ET and Contractor and verified by IEC, ER/SOR to signify the agreement in writing on such proposals and any other mitigation measures;</li> <li>3. Supervise the implementation of additional monitoring and/or any other mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the ER/SOR and confirm notification of the non-compliance in writing;</li> <li>2. Attend the meeting to discuss with ET, IEC and ER/SOR the necessity of additional dolphin monitoring and any other potential mitigation measures;</li> <li>3. Jointly submit with ET to IEC a proposal of additional dolphin monitoring and/or any other mitigation measures when necessary;</li> <li>4. Implement the agreed additional dolphin monitoring and/or any other mitigation measures.</li> </ol>

*Appendix L5 Event and Action Plan on Dolphin Acoustic Behaviour*

EVENT	ACTION			
	ET Leader	IEC	SO	Contractor
<p><u>Action Level</u></p> <p>With the numerical values presented in <i>Table 5.7 of Baseline Monitoring Report</i>, when any of the response variable for dolphin acoustic behaviour recorded in the construction phase monitoring is 20% lower or higher than that recorded in the baseline monitoring (see <i>Table 5.8 of Baseline Monitoring Report</i>), or when there is a difference of 20% in dolphin acoustic signal detection at nighttime period at Site C1 only, the action level should be triggered</p>	<ol style="list-style-type: none"> <li>1. Repeat statistical data analysis to confirm findings;</li> <li>2. Review all available and relevant data to ascertain if differences are as a result of natural variation or seasonal differences;</li> <li>3. Identify source(s) of impact;</li> <li>4. Inform the IEC, SO and Contractor;</li> <li>5. Check monitoring data;</li> <li>6. Carry out audit to ensure all dolphin protective measures are implemented fully and additional measures be proposed if necessary</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET and Contractor;</li> <li>2. Discuss monitoring with the ET and the Contractor;</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with the IEC the repeat monitoring and any other measures proposed by the ET;</li> <li>2. Make agreement on measures to be implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the SO and confirm notification of the non-compliance in writing;</li> <li>2. Discuss with the ET and the IEC and propose measures to the IEC and the SO;</li> <li>3. Implement the agreed measures.</li> </ol>

EVENT	ACTION			
	ET Leader	IEC	SO	Contractor
<p><u>Limit Level</u></p> <p>With the numerical values presented in Table 5.7 of <i>Baseline Monitoring Report</i>, when any of the response variable for dolphin acoustic behaviour recorded in the construction phase monitoring is 40% lower or higher than that recorded in the baseline monitoring (see Table 5.8 of <i>Baseline Monitoring Report</i>), or when there is a difference of 40% in dolphin acoustic signal detection at nighttime at Site C1 only, the limit level should be triggered</p>	<ol style="list-style-type: none"> <li>1. Repeat statistical data analysis to confirm findings;</li> <li>2. Review all available and relevant data to ascertain if differences are as a result of natural variation or seasonal differences;</li> <li>3. Identify source(s) of impact;</li> <li>4. Inform the IEC, SO and Contractor;</li> <li>5. Check monitoring data;</li> <li>6. Carry out audit to ensure all dolphin protective measures are implemented fully and additional measures be proposed if necessary</li> <li>7. Discuss additional dolphin monitoring and any other potential mitigation measures (eg consider to temporarily stop relevant portion of construction activity) with the IEC and Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET and Contractor;</li> <li>2. Discuss monitoring with the ET and the Contractor;</li> <li>3. Review proposals for additional monitoring and any other measures submitted by the Contractor and advise ER accordingly.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with the IEC the repeat monitoring and any other measures proposed by the ET;</li> <li>2. Make agreement on measures to be implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the SO and confirm notification of the non-compliance in writing;</li> <li>2. Discuss with the ET and the IEC and propose measures to the IEC and the SO;</li> <li>3. Implement the agreed measures.</li> </ol>

Abbreviations: ET – Environmental Team, IEC – Independent Environmental Checker, SO – Supervising Office, DEP – Director of Environmental Protection

Appendix M

## Monthly Summary of Waste Flow Table

Contract No. : HY/2012/07

Tuen Mun Chek Lap Kok Link – Southern Connection Viaduct Section

Monthly Summary Waste Flow Table for 2018 (Year)

Month/Material	Actual Quantities of Inert C&D Materials Generation						Actual Quantities of C&D wastes Generation						Actual Quantities of Recyclables Generation			
	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fills	Imported Fill	Marine Sediment, Cat. L	Marine Sediment, Cat. Mp	Marine Sediment, Cat. Mf	Marine Sediment, Cat. H	Chemical Waste	General Refuse	Metals	Felled trees	Paper/ cardboard packaging	Plastics
Unit	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000m <sup>3</sup> )	('000Kg)	('000Kg)	('000Kg)	('000Kg)	('000Kg)	('000Kg)
Jan	4.288	0.405	0.137	-	4.151	-	-	-	-	-	-	211.060	-	2.540	0.084	-
Feb	2.662	0.241	0.826	-	1.836	-	-	-	-	-	-	184.880	-	12.280	0.028	-
Mar	5.916	0.289	2.503	-	1.536	1.877	-	-	-	-	1.200	307.670	-	30.190	0.161	-
Apr	6.103	0.352	0.852	-	1.274	3.977	-	-	-	-	-	349.640	-	19.150	0.112	-
May	4.492	0.616	1.333	0.148	1.676	1.336	-	-	-	-	-	438.160	-	-	0.056	-
Jun	2.801	0.763	1.134	-	1.600	0.067	-	-	-	-	-	669.690	-	9.570	0.035	-
<b>SUB-TOTAL</b>	<b>26.262</b>	<b>2.666</b>	<b>6.783</b>	<b>0.148</b>	<b>12.074</b>	<b>7.257</b>	<b>-</b>	<b>-</b>	<b>-</b>	<b>-</b>	<b>1.200</b>	<b>2161.100</b>	<b>-</b>	<b>73.730</b>	<b>0.476</b>	<b>-</b>
Jul	1.361	0.555	0.208	-	0.973	0.181	-	-	-	-	-	639.210	-	13.260	0.035	-
Aug	-	0.000	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Sep	-	0.000	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Oct	-	0.000	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Nov	-	0.000	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Dec	-	0.000	-	-	-	-	-	-	-	-	-	-	-	-	-	-
<b>TOTAL</b>	<b>27.623</b>	<b>3.221</b>	<b>6.991</b>	<b>0.148</b>	<b>13.046</b>	<b>7.438</b>	<b>-</b>	<b>-</b>	<b>-</b>	<b>-</b>	<b>1.200</b>	<b>2,800.310</b>	<b>-</b>	<b>86.990</b>	<b>0.511</b>	<b>-</b>

Notes :

- 1 - The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- 2 - Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
- 3 - Broken concrete for recycling into aggregates.
- 4 - Assumed 5 kg per damaged water-filled barrier.
- 5 - Disposed as Public Fills includes Hard Rock and Large Broken Concrete.

Appendix N

Cumulative Statistics on  
Exceedances, Complaints,  
Notifications of Summons  
and Successful Prosecutions

**Appendix N1 Cumulative Statistics on Exceedances**

		Total No. recorded in this reporting month	Total No. recorded since project commencement
1-Hr TSP	Action	0	0
	Limit	0	1
24-Hr TSP	Action	0	2
	Limit	0	0
Noise	Action	0	0
	Limit	0	0
Water Quality	Action	4	145
	Limit	2	17
Impact Dolphin Monitoring	Action	0	11
	Limit	0	11

**Appendix N2 Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions**

Reporting Period	Cumulative Statistics		
	Complaints	Notifications of Summons	Successful Prosecutions
This Reporting Month (July 2018)	0	0	0
Total No. received since project commencement	14	0	0

Email  
message

**Environmental  
Resources  
Management**

**To** Ramboll Hong Kong Limited (ENPO)


**From** ERM- Hong Kong, Limited

**Ref/Project number** Contract No. HY/2012/07  
Tuen Mun – Chek Lap Kok Link – Southern  
Connection Viaduct Section

**Subject** Notification of Exceedance for Marine Water  
Quality Impact Monitoring

**Date** 5 July 2018

2507,  
25/F One Harbourfront,  
18 Tak Fung Street,  
Hung Hom, Hong Kong  
Telephone: (852) 2271 3113  
Facsimile: (852) 2723 5660  
E-mail: jovy.tam@erm.com

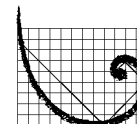

**ERM**

---

Dear Sir/ Madam,

Please find attached the Notification of Exceedance (NOE) of the following  
Log no.:

Action Level Exceedance  
0215660\_04 July 2018\_ Bottom-depth DO\_E\_Station SR4a

A total of one exceedance was recorded on 04 July 2018.

Regards,

A handwritten signature in black ink, appearing to be 'Jovy Tam'.

Mr Jovy Tam  
Environmental Team Leader

---

**CONFIDENTIALITY NOTICE**

This facsimile transmission is intended only for the use of the addressee and is confidential. If you are not the addressee it may be unlawful for you to read, copy, distribute, disclose or otherwise use the information in this facsimile. If you are not the intended recipient, please telephone or fax us immediately.

---





ERM-Hong Kong, Limited

CONTRACT NO. HY/2012/07

TUEN MUN – CHEK LAP KOK LINK –  
SOUTHERN CONNECTION VIADUCT SECTION

*Marine Water Quality Impact Monitoring*

**Notification of Exceedance**

<b>Log No.</b>	<u><b>Action Level Exceedance</b></u> <b>0215660_04 July 2018_ Bottom-depth DO_E_Station SR4a</b>  <b>[Total No. of Exceedances = 1]</b>	
<b>Date</b>	4 July 2018 (Measured) 5 July 2018 ( <i>In situ</i> results received by ERM) 10 July 2018 (Laboratory results received by ERM)	
<b>Monitoring Station</b>	CS(Mf)5, SR4a, SR4, IS8, IS(Mf)16, IS(Mf)9, CS(Mf)3(N)	
<b>Parameter(s) with Exceedance(s)</b>	Bottom-depth Dissolved Oxygen (DO)	
<b>Action Levels for DO</b>	Bottom-depth DO	4.7 mg/L
<b>Limit Levels for DO</b>	Bottom-depth DO	3.6 mg/L
<b>Measured Levels</b>	<u><b>Action Level Exceedance</b></u> 1. Mid-ebb at SR4a (Bottom-depth DO = 3.9mg/L)	
<b>Works Undertaken (at the time of monitoring event)</b>	No major marine works was undertaken under this Contract on 4 July 2018.	
<b>Possible Reason for Action or Limit Level Exceedance(s)</b>	The exceedance of bottom-depth DO is unlikely to be due to the Project, in view of the following: <ul style="list-style-type: none"> <li>• No marine works was undertaken under this Contract on 4 July 2018.</li> <li>• Apart from DO exceedance at SR4a, levels of DO at all monitoring stations were in compliance with the Action and Limit Levels during both mid-ebb and mid-flood tides on the same day.</li> <li>• DO levels were generally lower at water quality monitoring stations due to two possible reasons of natural variation:             <ol style="list-style-type: none"> <li>1. Natural ability for water to hold dissolved oxygen is reduced due to higher water temperature in summer months.</li> <li>2. The higher Salinity recorded at the bottom level of SR4a was possibly caused by the stratification of seawater during summer when the freshwater discharged from the Pearl River tended to form a surface layer of lower salinity water, which is probably responsible for the lower Salinity recorded at the surface and middle levels compared to the higher Salinity recorded at the bottom level of the monitoring stations. The stratification of seawater in the water column is likely a contributing factor to the results of lower levels of DO at the bottom level.</li> </ol> </li> </ul>	
<b>Actions Taken/ To Be Taken</b>	No immediate action is considered necessary. The ET will monitor for future trends in exceedances.	
<b>Remarks</b>	The monitoring results on 4 July 2018 and locations of water quality monitoring stations are attached. Site photo record on 4 July 2018 is attached.	


Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Level	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO (mg/L)	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	Surface	1	29.0	7.9	17.8	5.9	5.8	7.9	7.2	6.5	6.8
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	Surface	2	28.9	7.9	18.0	5.9		6.7		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	Middle	1	28.8	7.9	18.3	5.7		7.2		7.7	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	Middle	2	28.7	7.9	18.5	5.7		7.6		7.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	Bottom	1	28.5	7.9	19.6	5.4	5.4	7.6		6.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)5	16:24	Bottom	2	28.4	7.9	19.9	5.4		6.1		6.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	Surface	1	29.6	8.0	14.9	6.1	5.9	4.2	3.9	5.6	6.7
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	Surface	2	29.5	8.1	14.8	6.4		4.4		6.2	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	Middle	1	28.7	8.0	16.6	5.5		3.6		7.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	Middle	2	28.6	8.0	16.6	5.7		3.8		6.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	Bottom	1	28.8	7.9	21.4	4.4	4.6	3.5		6.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	CS(Mf)3(N)	15:20	Bottom	2	28.0	7.9	21.6	4.7		3.7		7.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	Surface	1	28.9	7.8	18.7	5.4	5.4	8.2	6.6	6.9	7.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	Surface	2	28.8	7.9	18.8	5.4		7.2		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	Middle	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	Bottom	1	28.2	7.8	20.1	5.0	5.0	5.8		8.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)16	16:02	Bottom	2	28.1	7.9	20.3	5.0		5.3		8.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	Surface	1	29.3	7.9	17.9	5.8	5.8	5.5	12.8	6.6	7.3
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	Surface	2	29.2	7.9	18.1	5.8		4.6		6.9	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	Middle	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	Bottom	1	28.4	7.7	20.4	3.9	3.9	21.1		7.5	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4a	15:51	Bottom	2	28.2	7.8	20.6	3.9	20.1	8.1			
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	Surface	1	29.2	7.8	18.0	5.7	5.7	6.6	5.6	7.2	7.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	Surface	2	29.1	7.9	18.2	5.7		5.9		7.7	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	Middle	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	Bottom	1	28.7	7.8	18.5	5.5	5.5	5.3		7.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	SR4(N)	15:47	Bottom	2	28.5	7.9	18.6	5.5		4.6		7.3	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	Surface	1	29.8	7.9	17.7	6.3	6.3	5.7	9.4	9.4	9.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	Surface	2	29.7	8.0	17.9	6.3		4.9		8.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	Middle	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	Bottom	1					5.3	14.0		9.5	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS8	15:41	Bottom	2	28.6	7.9	18.9	5.3		13.0		9.9	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	Surface	1	29.6	7.9	17.8	6.5	6.5	4.0	5.7	4.6	5.0
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	Surface	2	29.5	8.0	18.0	6.5		3.7		5.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	Middle	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	Bottom	1	29.7	7.9	18.4	6.4	6.5	7.6		5.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Ebb	IS(Mf)9	15:34	Bottom	2	29.6	8.0	18.6	6.5		7.6		4.7	

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Level	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO (mg/L)	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	Surface	1	28.6	7.8	16.4	5.6	5.3	4.6	5.4	6.7	6.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	Surface	2	28.7	7.8	16.3	5.6		5.5		5.9	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	Middle	1	28.2	7.9	19.5	5.0		3.8		7.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	Middle	2	28.3	7.8	19.4	5.0	4.1	4.3	5.4	6.3	6.5
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	Bottom	1	26.8	7.8	26.4	4.1		7.0		6.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)5	9:31	Bottom	2	26.9	7.8	26.2	4.1	5.8	7.3	6.7	6.3	5.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	Surface	1	29.0	8.0	14.6	6.0		4.1		5.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	Surface	2	29.1	7.9	14.8	5.8		4.6		4.6	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	Middle	1	28.7	8.0	15.6	5.7	5.2	8.9	6.7	5.5	5.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	Middle	2	28.8	7.9	15.8	5.5		8.0		5.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	Bottom	1	28.9	8.0	17.9	5.3	5.6	7.5	5.5	6.5	7.2
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	CS(Mf)3(N)	10:38	Bottom	2	28.9	7.9	18.0	5.0		7.1		5.5	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	Surface	1	28.5	7.9	18.0	5.6	5.6	4.4	5.5	6.8	7.2
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	Surface	2	28.7	7.9	17.8	5.6		5.0		7.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	Middle	2					5.2		5.5		7.2
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	Bottom	1	28.4	7.9	18.9	5.2		5.8		6.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)16	9:57	Bottom	2	28.5	7.8	18.8	5.2	5.6	6.6	12.1	7.9	8.9
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	Surface	1	28.6	7.9	17.6	5.6		6.3		8.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	Surface	2	28.7	7.9	17.4	5.6		6.7		9.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	Middle	1					5.3		5.7		6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	Middle	2									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	Bottom	1	28.4	7.8	17.9	5.3	5.4	16.2	5.7	8.9	6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4a	10:06	Bottom	2	28.5	7.8	17.7	5.3		19.0		9.5	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	Surface	1	28.5	7.9	17.8	5.4	5.4	5.7	5.7	6.1	6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	Surface	2	28.7	7.8	17.6	5.4		6.1		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	Middle	2					5.4		5.7		6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	Bottom	1	28.5	7.9	18.6	5.4		5.3		6.7	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	SR4(N)	10:11	Bottom	2	28.6	7.8	18.3	5.4	5.7	5.5	10.2	6.8	6.3
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	Surface	1	28.7	7.9	17.1	5.6		5.3		5.8	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	Surface	2	28.8	7.9	16.9	5.7		5.5		5.4	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	Middle	1					4.9		10.2		6.3
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	Middle	2						15.3		6.7	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	Bottom	1	28.4	7.8	19.7	4.9	5.8	14.6	5.6	7.2	6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS8	10:20	Bottom	2	28.5	7.8	19.3	4.9		5.0		6.1	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	Surface	1	28.8	7.9	17.2	5.8	5.8	5.4	5.6	6.4	6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	Surface	2	28.9	7.9	17.0	5.8					
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	Middle	1									
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	Middle	2					5.7		5.6		6.4
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	Bottom	1	28.7	7.9	17.4	5.7		5.8		6.0	
TMCLKL	HY/2012/07	2018-07-04	Mid-Flood	IS(Mf)9	10:27	Bottom	2	28.8	7.9	17.2	5.7	6.2	7.2			

Note: Indicates Exceedance of Action Level  
Indicates Exceedance of Limit Level

Photo 1 - Mid-Ebb at SR4a on 4 July 2018



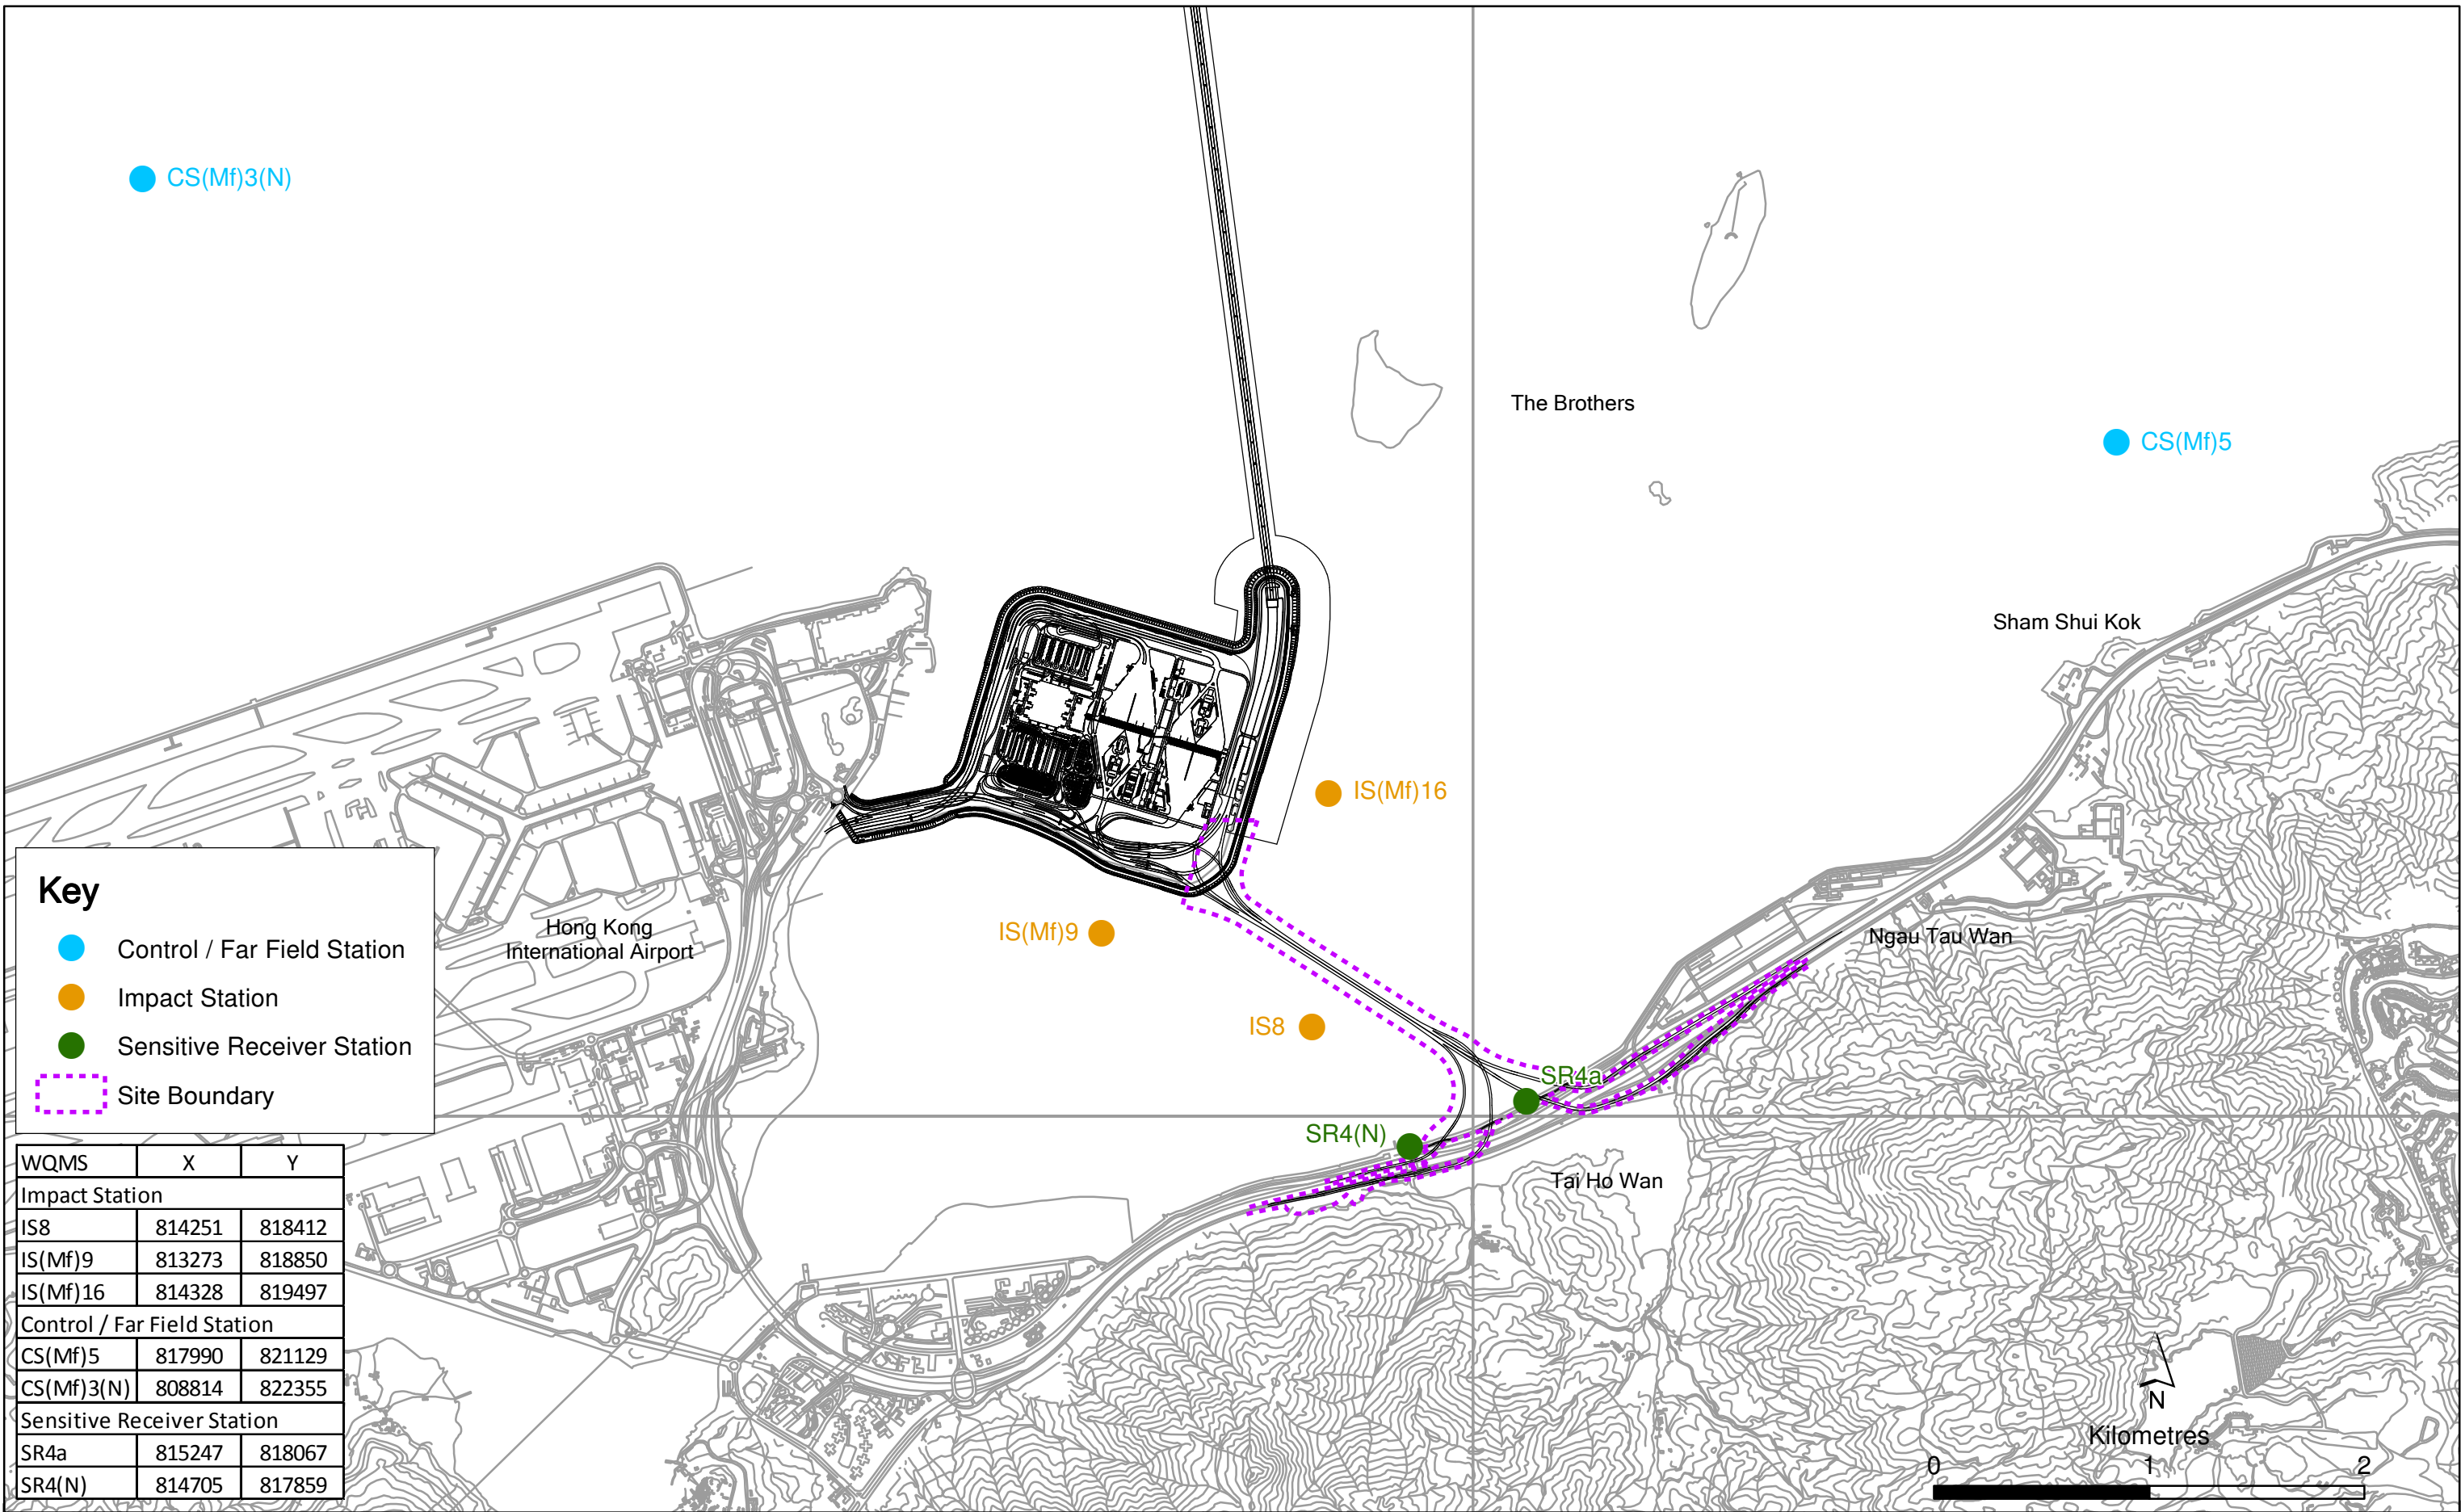

**Key**

- Control / Far Field Station
- Impact Station
- Sensitive Receiver Station
- Site Boundary

WQMS	X	Y
<b>Impact Station</b>		
IS8	814251	818412
IS(Mf)9	813273	818850
IS(Mf)16	814328	819497
<b>Control / Far Field Station</b>		
CS(Mf)5	817990	821129
CS(Mf)3(N)	808814	822355
<b>Sensitive Receiver Station</b>		
SR4a	815247	818067
SR4(N)	814705	817859

Locations of Water Quality Monitoring Stations

File: T:\GIS\CONTRACT\0215660\Mxd\0215660\_WQMS.mxd  
Date: 20/3/2018

Email  
message

Environmental  
Resources  
Management

**To** Ramboll Hong Kong Limited (ENPO)

**From** ERM- Hong Kong, Limited

**Ref/Project number** Contract No. HY/2012/07  
Tuen Mun – Chek Lap Kok Link – Southern  
Connection Viaduct Section

**Subject** Notification of Exceedance for Marine Water  
Quality Impact Monitoring

**Date** 10 July 2018

2507,  
25/F One Harbourfront,  
18 Tak Fung Street,  
Hung Hom, Hong Kong  
Telephone: (852) 2271 3113  
Facsimile: (852) 2723 5660  
E-mail: jovy.tam@erm.com



**ERM**

---

Dear Sir/ Madam,

Please find attached the Notification of Exceedance (NOE) of the following  
Log no.:

Action Level Exceedance

0215660\_09 July 2018\_ Bottom-depth DO\_E\_Station IS(Mf)16

0215660\_09 July 2018\_ Bottom-depth DO\_E\_Station SR4a

0215660\_09 July 2018\_ Bottom-depth DO\_E\_Station IS8

Limit Level Exceedance

0215660\_09 July 2018\_ Bottom-depth DO\_F\_Station SR4a

A total of four exceedances were recorded on 09 July 2018.

Regards,

A handwritten signature in black ink, appearing to be 'Jovy Tam'.

Mr Jovy Tam  
Environmental Team Leader

---

**CONFIDENTIALITY NOTICE**

This facsimile transmission is intended only for the use of the addressee and is confidential. If you are not the addressee it may be unlawful for you to read, copy, distribute, disclose or otherwise use the information in this facsimile. If you are not the intended recipient, please telephone or fax us immediately.

---



ERM-Hong Kong, Limited

CONTRACT NO. HY/2012/07

TUEN MUN – CHEK LAP KOK LINK –  
SOUTHERN CONNECTION VIADUCT SECTION

Marine Water Quality Impact Monitoring

Notification of Exceedance

<b>Log No.</b>	<p style="text-align: center;"><u>Action Level Exceedances</u>            0215660_09 July 2018_ Bottom-depth DO_E_Station IS(Mf)16            0215660_09 July 2018_ Bottom-depth DO_E_Station SR4a            0215660_09 July 2018_ Bottom-depth DO_E_Station IS8            0215660_09 July 2018_ Bottom-depth DO_F_Station SR4a</p> <p style="text-align: center;">[Total No. of Exceedances = 4]</p>	
<b>Date</b>	<p style="text-align: center;">09 July 2018 (Measured)            10 July 2018 (<i>In situ</i> results received by ERM)            16 July 2018 (Laboratory results received by ERM)</p>	
<b>Monitoring Station</b>	<p style="text-align: center;">CS(Mf)5, SR4a, SR4, IS8, IS(Mf)16, IS(Mf)9, CS(Mf)3(N)</p>	
<b>Parameter(s) with Exceedance(s)</b>	<p style="text-align: center;">Bottom-depth Dissolved Oxygen (DO)</p>	
<b>Action Levels for DO</b>	<p style="text-align: center;">Bottom-depth DO</p>	<p style="text-align: center;">4.7 mg/L</p>
<b>Limit Levels for DO</b>	<p style="text-align: center;">Bottom-depth DO</p>	<p style="text-align: center;">3.6 mg/L</p>
<b>Measured Levels</b>	<p><u>Action Level Exceedance</u></p> <ol style="list-style-type: none"> <li>1. Mid-ebb at IS(Mf)16 (Bottom-depth DO = 4.3mg/L);</li> <li>2. Mid-ebb at SR4a (Bottom-depth DO = 3.6mg/L);</li> <li>3. Mid-ebb at IS8 (Bottom-depth DO = 4.3mg/L);</li> <li>4. Mid-flood at SR4a (Bottom-depth DO = 3.4mg/L).</li> </ol>	
<b>Works Undertaken (at the time of monitoring event)</b>	<p>No major marine works was undertaken under this Contract on 09 July 2018.</p>	
<b>Possible Reason for Action or Limit Level Exceedance(s)</b>	<p>The exceedance of bottom-depth DO is unlikely to be due to the Project, in view of the following:</p> <ul style="list-style-type: none"> <li>• No marine works was undertaken under this Contract on 09 July 2018.</li> <li>• Apart from the DO exceedances at the bottom level, surface and middle levels of DO at all monitoring stations were in compliance with the Action and Limit Levels during both mid-ebb and mid-flood tides on the same day.</li> <li>• The DO patterns at SR4a, IS(Mf)16 and IS8 were similar to the control station where the bottom-depth DO levels were generally lower. DO levels were generally lower at water quality monitoring stations due to reduce in natural ability for water to hold dissolved oxygen under higher water temperature in summer months. In addition, lower bottom-depth DO levels may possibly caused by the stratification of seawater during summer when the freshwater discharged from the Pearl River tended to form a surface layer of lower salinity water, which is probably responsible for the lower Salinity recorded at the surface and middle levels compared to the higher Salinity recorded at the bottom level of the monitoring stations. The stratification of seawater in the water column is likely a contributing factor to the results of lower levels of DO at the bottom level.</li> </ul>	
<b>Actions Taken/ To Be Taken</b>	<p>No immediate action is considered necessary. The ET will monitor for future trends in exceedances.</p>	
<b>Remarks</b>	<p>The monitoring results on 09 July 2018 and locations of water quality monitoring stations are attached. Site photo record on 09 July 2018 is attached.</p>	

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Level	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO (mg/L)	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)5	9:00	Surface	1	27.5	8.2	22.4	5.4	4.4	3.0	3.7	4.8	5.0
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)5	9:00	Surface	2	27.5	8.1	22.5	5.5		2.2		4.4	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)5	9:00	Middle	1	25.3	8.0	29.6	3.4		4.3		4.5	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)5	9:00	Middle	2	25.3	8.0	29.8	3.4	3.0	3.0	3.7	3.7	5.0
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)5	9:00	Bottom	1	24.8	8.0	30.9	3.0		4.8		6.5	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)5	9:00	Bottom	2	24.8	8.0	31.2	2.9	4.4	5.0	6.2	5.8	4.9
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)3(N)	10:07	Surface	1	28.5	8.1	17.4	6.2		1.8		3.4	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)3(N)	10:07	Surface	2	28.3	8.0	17.4	6.1		1.5		3.8	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)3(N)	10:07	Middle	1	26.8	7.9	26.0	2.5	2.6	8.9	6.2	5.6	4.9
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)3(N)	10:07	Middle	2	26.7	7.8	26.2	2.6		8.0		5.0	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)3(N)	10:07	Bottom	1	26.7	7.9	26.3	2.5	7.6	9.0	4.9	5.3	4.9
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	CS(Mf)3(N)	10:07	Bottom	2	26.6	7.8	26.6	2.6		8.0		6.3	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)16	9:37	Surface	1	28.5	8.4	19.6	7.5	7.6	4.9	4.9	3.8	4.9
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)16	9:37	Surface	2	28.5	8.3	19.7	7.6		3.5		4.9	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)16	9:37	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)16	9:37	Middle	2					4.3		8.6		9.5
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)16	9:37	Bottom	1	26.1	8.1	26.9	4.4		5.5		5.1	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)16	9:37	Bottom	2	26.2	8.0	27.2	4.2	5.5	5.9			
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4a	9:46	Surface	1	28.5	8.2	19.9	6.1	6.2	4.6	8.6	7.4	9.5
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4a	9:46	Surface	2	28.5	8.1	20.1	6.2		3.4		6.4	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4a	9:46	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4a	9:46	Middle	2					3.6		8.6		9.5
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4a	9:46	Bottom	1	26.6	8.0	26.1	3.6		13.2		12.2	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4a	9:46	Bottom	2	26.6	7.9	26.3	3.5	13.0	11.9			
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4(N)	9:52	Surface	1	28.9	8.2	16.8	6.9	6.9	4.7	4.5	5.4	4.9
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4(N)	9:52	Surface	2	28.9	8.1	16.9	6.9		4.3		4.5	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4(N)	9:52	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4(N)	9:52	Middle	2					6.4		4.5		4.9
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4(N)	9:52	Bottom	1	28.7	8.2	18.7	6.4		4.7		4.7	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	SR4(N)	9:52	Bottom	2	28.8	8.2	19.0	6.4	4.4	4.8			
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS8	9:59	Surface	1	28.2	8.1	20.8	5.3	5.3	5.0	5.8	7.0	7.2
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS8	9:59	Surface	2	28.2	8.1	20.8	5.3		3.8		6.7	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS8	9:59	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS8	9:59	Middle	2					4.3		5.8		7.2
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS8	9:59	Bottom	1	27.5	8.1	22.8	4.3		7.2		7.0	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS8	9:59	Bottom	2	27.6	8.0	23.0	4.3	7.3	7.9			
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)9	10:05	Surface	1					8.3		5.2		5.5
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)9	10:05	Surface	2									
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)9	10:05	Middle	1	29.1	8.4	18.2	8.3		5.0		5.4	
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)9	10:05	Middle	2	29.1	8.3	18.3	8.2	5.3	5.5			
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)9	10:05	Bottom	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Ebb	IS(Mf)9	10:05	Bottom	2									



Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Level	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO (mg/L)	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)5	16:13	Surface	1	27.8	8.4	23.7	7.6	5.4	3.6	6.5	9.4	9.8
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)5	16:13	Surface	2	27.8	8.3	23.8	7.7		3.3		10.1	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)5	16:13	Middle	1	25.3	8.0	29.5	3.1		3.4		9.8	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)5	16:13	Middle	2	25.3	7.9	29.7	3.2	3.9	10.6			
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)5	16:13	Bottom	1	24.7	8.0	31.3	2.9	12.4	9.0			
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)5	16:13	Bottom	2	24.7	7.9	31.5	2.8	12.3	9.7			
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)3(N)	15:01	Surface	1	28.8	8.0	17.7	6.8	6.7	3.9	5.2	3.6	3.5
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)3(N)	15:01	Surface	2	29.0	8.2	17.5	6.8		3.9		3.9	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)3(N)	15:01	Middle	1	28.8	8.0	17.7	6.5		8.0		3.0	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)3(N)	15:01	Middle	2	28.9	8.1	17.6	6.6	8.2	3.6			
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)3(N)	15:01	Bottom	1	27.4	7.9	22.4	4.6	4.6	3.6		3.2	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	CS(Mf)3(N)	15:01	Bottom	2	27.6	8.0	22.1	4.6	4.6	3.6	3.6		
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)16	15:41	Surface	1	28.8	8.6	20.8	10.3	10.4	1.3	4.7	9.1	8.3
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)16	15:41	Surface	2	28.8	8.5	21.0	10.5		3.4		8.4	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)16	15:41	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)16	15:41	Middle	2									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)16	15:41	Bottom	1	27.6	8.2	23.4	5.9	5.9	7.1		7.6	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)16	15:41	Bottom	2	27.6	8.1	23.6	5.8	5.9	7.1	8.1		
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4a	15:30	Surface	1	28.2	8.2	22.1	6.0	6.0	7.6	10.2	7.3	7.5
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4a	15:30	Surface	2	28.2	8.1	22.2	6.0		6.1		6.9	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4a	15:30	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4a	15:30	Middle	2									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4a	15:30	Bottom	1	26.5	8.0	26.6	3.4	3.4	13.6		8.1	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4a	15:30	Bottom	2	26.6	7.9	26.8	3.3	3.4	13.3	7.7		
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4(N)	15:25	Surface	1	28.2	8.2	21.8	6.4	6.5	5.6	6.6	6.9	8.2
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4(N)	15:25	Surface	2	28.2	8.1	22.0	6.5		5.6		7.0	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4(N)	15:25	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4(N)	15:25	Middle	2									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4(N)	15:25	Bottom	1	27.9	8.1	22.7	5.3	5.3	7.6		9.0	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	SR4(N)	15:25	Bottom	2	28.0	8.0	22.8	5.3	5.3	7.6	10.0		
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS8	15:18	Surface	1	29.6	8.6	19.8	11.3	11.4	3.8	7.4	7.2	7.8
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS8	15:18	Surface	2	29.6	8.5	20.0	11.4		3.7		7.2	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS8	15:18	Middle	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS8	15:18	Middle	2									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS8	15:18	Bottom	1	27.4	8.1	23.7	5.4	5.3	10.9		8.8	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS8	15:18	Bottom	2	27.4	8.0	24.1	5.2	5.3	11.0	7.9		
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)9	15:11	Surface	1					7.9		8.5		10.2
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)9	15:11	Surface	2									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)9	15:11	Middle	1	28.3	8.4	22.3	7.9		8.5		10.7	
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)9	15:11	Middle	2	28.3	8.3	22.6	7.9	8.5	9.6			
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)9	15:11	Bottom	1									
TMCLKL	HY/2012/07	2018/07/09	Mid-Flood	IS(Mf)9	15:11	Bottom	2									

Note: Indicates Exceedance of Action Level  
Indicates Exceedance of Limit Level

Photo 1 - Mid-Ebb at IS(Mf)16 on 9 July 2018




Photo 2 - Mid-Ebb at SR4a on 9 July 2018




Photo 3 - Mid-Ebb at IS8 on 9 July 2018



Photo 4 - Mid-Flood at SR4a on 9 July 2018

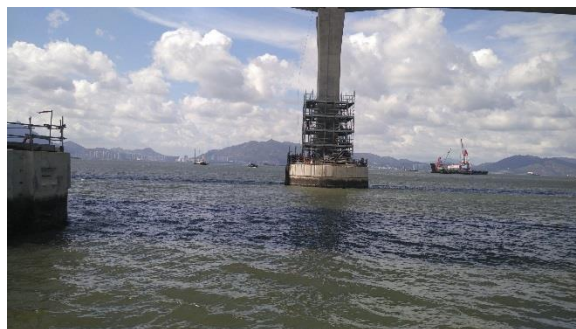

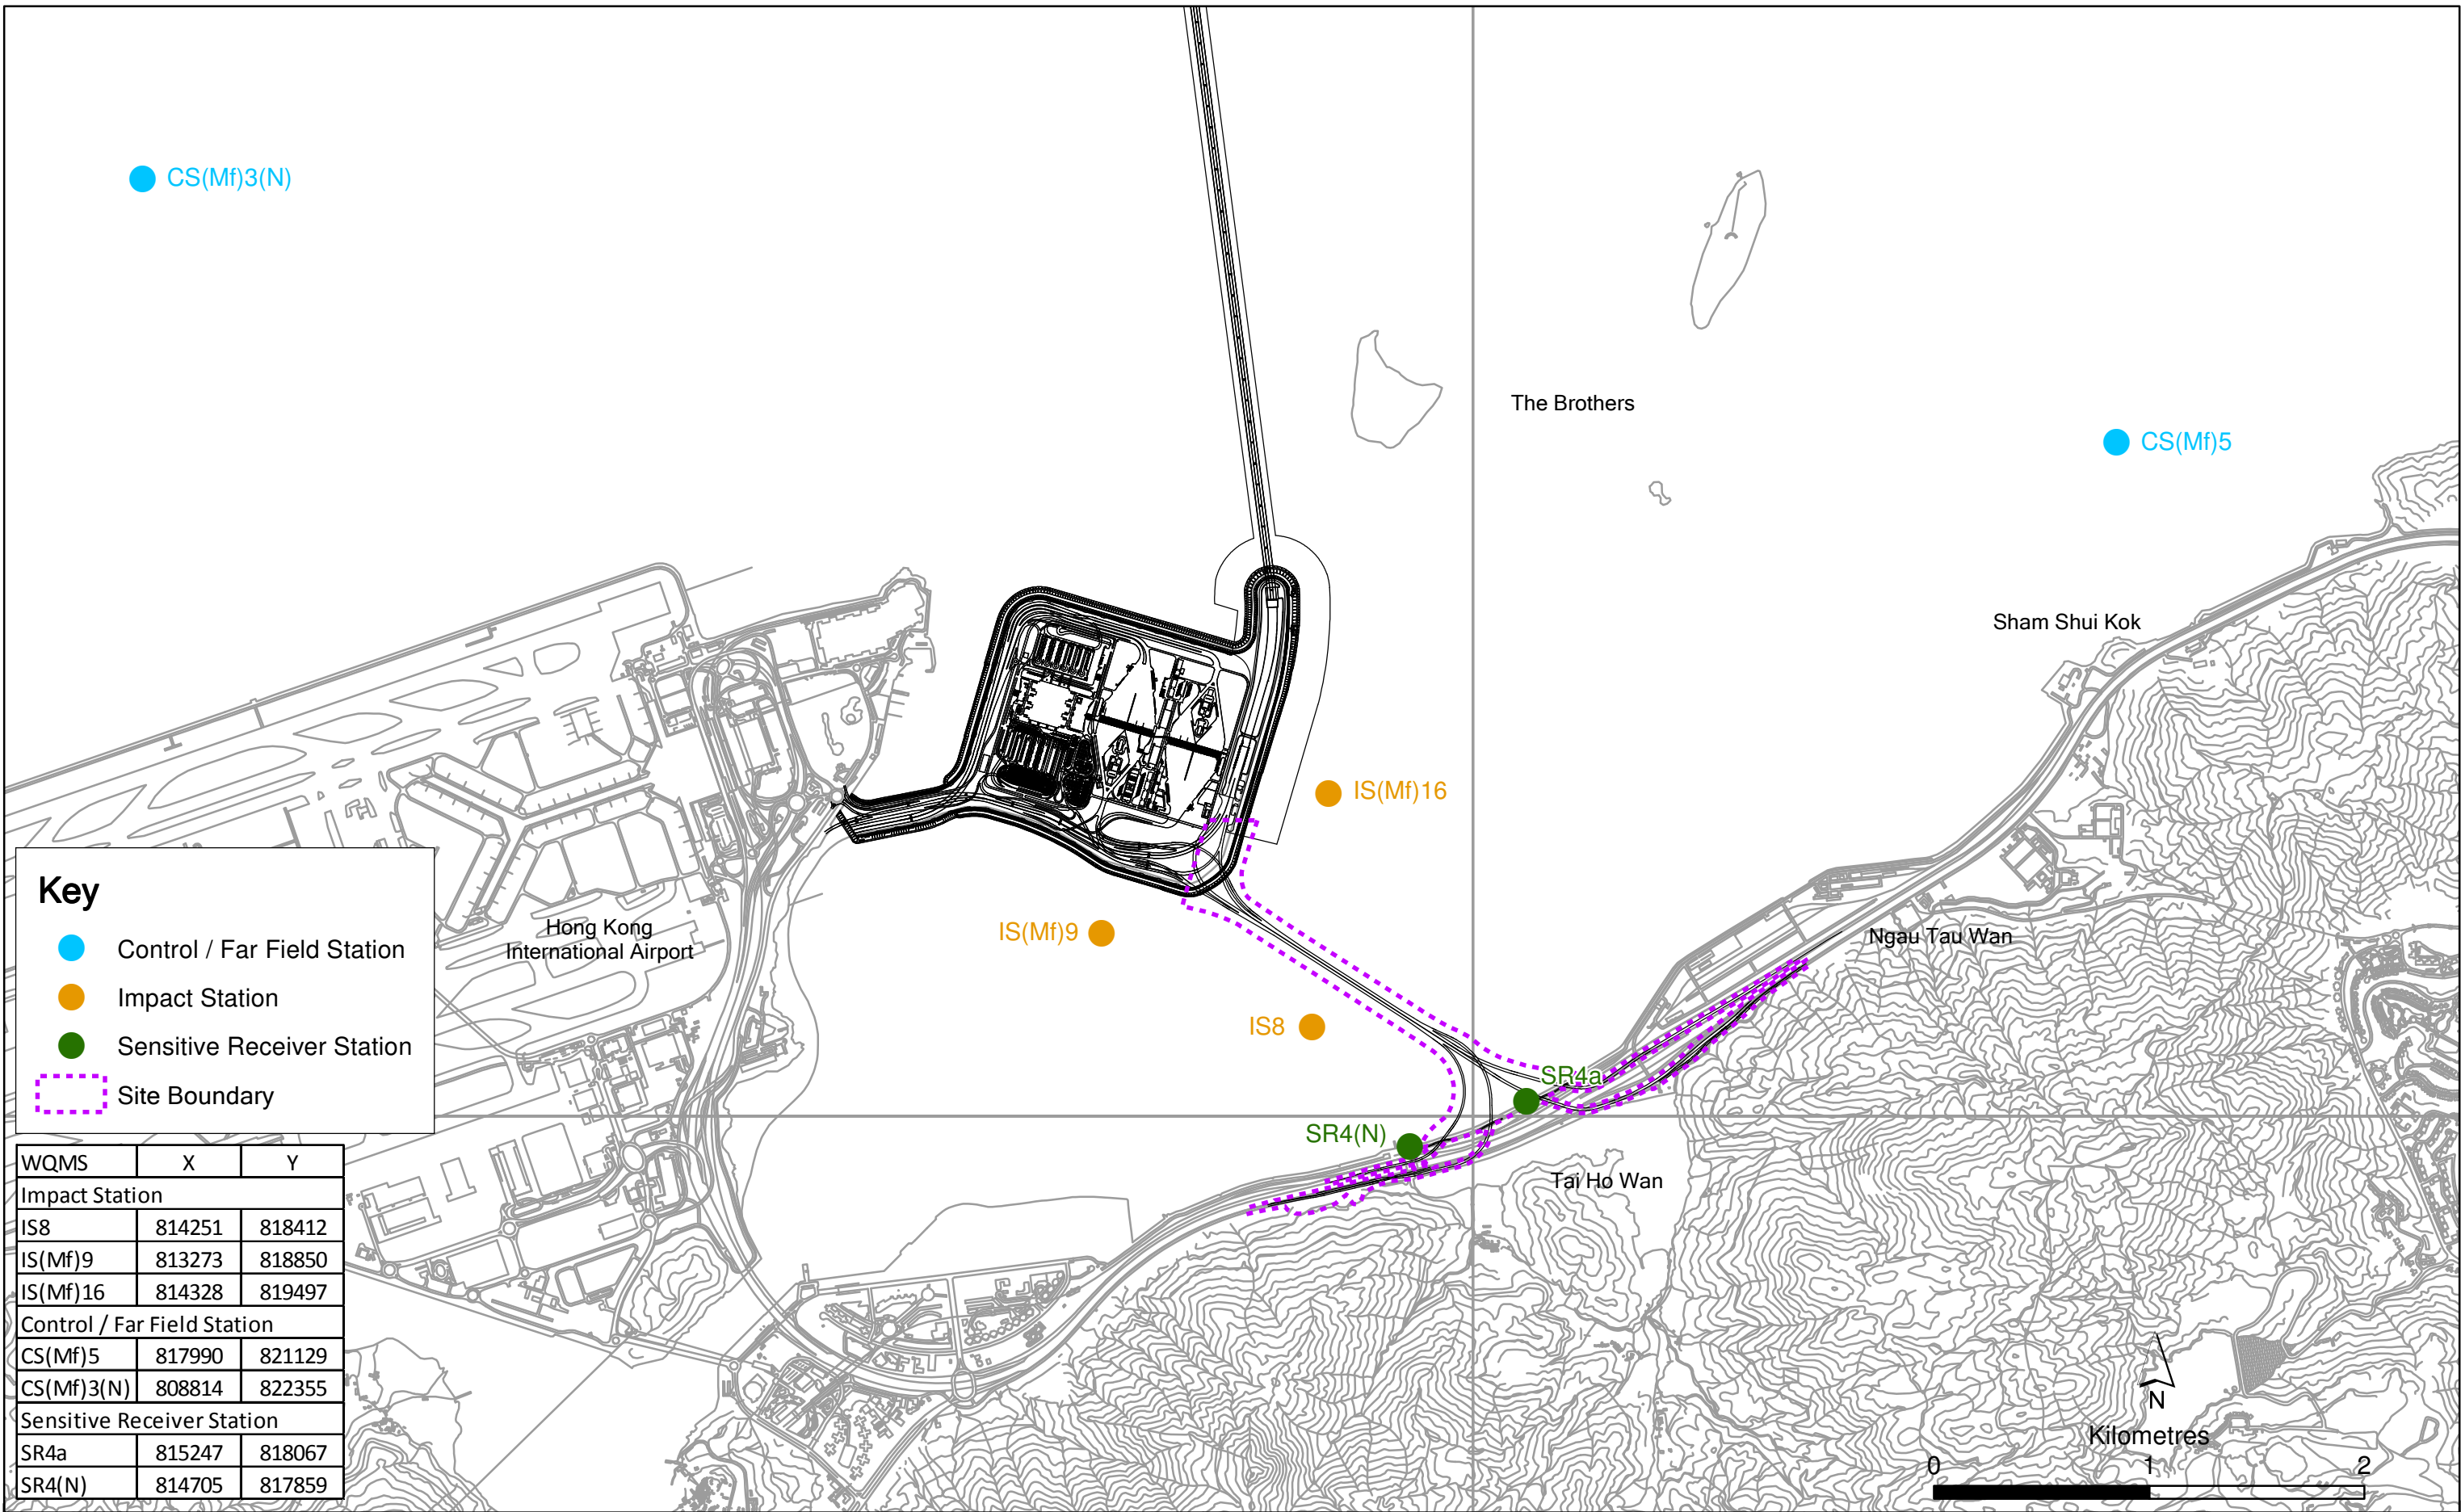

**Key**

- Control / Far Field Station
- Impact Station
- Sensitive Receiver Station
- Site Boundary

WQMS	X	Y
<b>Impact Station</b>		
IS8	814251	818412
IS(Mf)9	813273	818850
IS(Mf)16	814328	819497
<b>Control / Far Field Station</b>		
CS(Mf)5	817990	821129
CS(Mf)3(N)	808814	822355
<b>Sensitive Receiver Station</b>		
SR4a	815247	818067
SR4(N)	814705	817859

Locations of Water Quality Monitoring Stations

File: T:\GIS\CONTRACT\0215660\Mxd\0215660\_WQMS.mxd  
Date: 20/3/2018

Email  
message

Environmental  
Resources  
Management

**To** Ramboll Hong Kong Limited (ENPO)

**From** ERM- Hong Kong, Limited

**Ref/Project number** Contract No. HY/2012/07  
Tuen Mun – Chek Lap Kok Link – Southern  
Connection Viaduct Section

**Subject** Notification of Exceedance for Marine Water  
Quality Impact Monitoring

**Date** 06 August 2018

2507,  
25/F One Harbourfront,  
18 Tak Fung Street,  
Hung Hom, Hong Kong  
Telephone: (852) 2271 3113  
Facsimile: (852) 2723 5660  
E-mail: jovy.tam@erm.com



**ERM**

---

Dear Sir/ Madam,

Please find attached the Notification of Exceedance (NOE) of the following  
Log no.:

Limit Level Exceedance  
0215660\_25 July 2018\_Depth-averaged SS\_F\_Station SR4a

A total of one exceedance was recorded on 25 July 2018.

Regards,

A handwritten signature in black ink, appearing to be 'Jovy Tam', written in a cursive style.

Mr Jovy Tam  
Environmental Team Leader

---

**CONFIDENTIALITY NOTICE**

This facsimile transmission is intended only for the use of the addressee and is confidential. If you are not the addressee it may be unlawful for you to read, copy, distribute, disclose or otherwise use the information in this facsimile. If you are not the intended recipient, please telephone or fax us immediately.

---



ERM-Hong Kong, Limited

CONTRACT NO. HY/2012/07

TUEN MUN – CHEK LAP KOK LINK –  
SOUTHERN CONNECTION VIADUCT SECTION

*Marine Water Quality Impact Monitoring*

**Notification of Exceedance**

<b>Log No.</b>	<u>Limit Level Exceedance</u> <b>0215660_25 July 2018_Depth-averaged SS_F_Station SR4a</b>  <b>[Total No. of Exceedance = 1]</b>	
<b>Date</b>	25 July 2018 (Measured) 26 July 2018 ( <i>In situ</i> results received by ERM) 04 August 2018 (Laboratory results received by ERM)	
<b>Monitoring Station</b>	CS(Mf)5, SR4a, SR4, IS8, IS(Mf)16, IS(Mf)9, CS(Mf)3(N)	
<b>Parameter(s) with Exceedance(s)</b>	Depth-averaged Suspended Solids (SS)	
<b>Action Levels for SS</b>	Depth-averaged SS	23.5 mg/L
<b>Limit Levels for SS</b>	Depth-averaged SS	34.4 mg/L
<b>Measured Levels</b>	<u>Limit Level Exceedance</u> 1. Mid-flood at SR4a (Depth-averaged SS = 35.7 mg/L)	
<b>Works Undertaken (at the time of monitoring event)</b>	No major marine works was undertaken under this Contract on 25 July 2018.	
<b>Possible Reason for Action or Limit Level Exceedance(s)</b>	The exceedance of depth-averaged SS is unlikely to be due to the Project, in view of the following: <ul style="list-style-type: none"> <li>• No marine works was undertaken under this Contract on 25 July 2018.</li> <li>• Apart from SS exceedance at SR4a during mid-flood tide, levels of SS at all monitoring stations were in compliance with the Action and Limit Levels during both mid-ebb and mid-flood tides on the same day.</li> <li>• Levels of turbidity at all monitoring stations were in compliance with the Action and Limit Levels during both mid-ebb and mid-flood tides on the same day.</li> <li>• No effluent discharge from platforms and work areas was observed during the sampling on the same day (refer to <i>Site Photo Record</i>).</li> </ul>	
<b>Actions Taken/ To Be Taken</b>	No immediate action is considered necessary. The ET will monitor for future trends in exceedances.	
<b>Remarks</b>	The monitoring results on 25 July 2018 and locations of water quality monitoring stations are attached. Site photo record on 25 July 2018 is attached.	

Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Level	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO (mg/L)	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	Surface	1	29.3	8.1	19.9	7.1	6.7	4.3	7.3	7.8	8.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	Surface	2	29.2	8.0	20.1	7.1		4.1		8.2	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	Middle	1	28.8	8.0	23.3	6.3		7.7		9.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	Middle	2	28.6	8.0	23.4	6.3		7.2		8.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	Bottom	1	28.5	8.0	27.0	5.4	5.4	10.5		9.5	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)5	11:15	Bottom	2	28.4	8.0	27.2	5.4		10.1		9.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	Surface	1	29.7	8.2	17.0	7.6	7.4	7.7	10.7	5.5	5.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	Surface	2	29.7	8.2	17.2	7.5		8.8		5.2	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	Middle	1	29.3	8.2	17.5	7.3		9.5		5.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	Middle	2	29.3	8.2	17.8	7.1		10.5		5.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	Bottom	1	28.9	8.1	21.2	6.2	6.2	13.9		5.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	CS(Mf)3(N)	12:49	Bottom	2	28.9	8.1	21.5	6.1		13.6		5.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	Surface	1	29.1	8.1	22.2	7.2	7.2	6.5	6.6	8.7	10.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	Surface	2	28.9	8.1	22.4	7.2		5.9		9.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	Middle	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	Middle	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	Bottom	1	28.7	8.0	23.7	6.5	6.6	7.4		11.1	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)16	11:49	Bottom	2	28.6	8.1	23.9	6.6		6.5		11.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	Surface	1	29.1	8.1	22.0	6.6	6.6	9.3	12.0	9.1	11.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	Surface	2	29.0	8.1	22.2	6.5		9.0		9.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	Middle	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	Middle	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	Bottom	1	28.9	7.9	22.6	5.4	5.4	14.9		13.8	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4a	11:58	Bottom	2	28.7	7.9	22.8	5.3		14.8		12.8	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	Surface	1	29.1	8.1	21.9	7.0	7.0	8.6	12.6	7.2	7.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	Surface	2	28.9	8.1	22.2	6.9		8.1		6.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	Middle	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	Middle	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	Bottom	1	29.0	8.0	22.5	6.0	6.1	17.0		8.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	SR4(N)	12:05	Bottom	2	28.8	8.0	22.7	6.1		16.8		8.1	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	Surface	1	29.5	8.2	21.3	8.2	8.2	4.0	6.1	7.0	7.4
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	Surface	2	29.4	8.2	21.5	8.2		3.8		7.2	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	Middle	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	Middle	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	Bottom	1	29.0	8.1	22.3	6.9	7.0	8.3		8.1	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS8	12:11	Bottom	2	28.8	8.1	22.5	7.0		8.2		7.4	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	Surface	1					7.5		5.3		7.0
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	Surface	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	Middle	1	29.2	8.2	21.7	7.5		5.2		7.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	Middle	2	29.0	8.1	21.9	7.5		5.3		6.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	Bottom	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Ebb	IS(Mf)9	12:20	Bottom	2									


Project	Works	Date (yyyy-mm-dd)	Tide	Station	Start Time	Level	Replicate	Temperature (°C)	pH	Salinity (ppt)	DO (mg/L)	Average DO (mg/L)	Turbidity (NTU)	Depth-Averaged Turbidity	SS (mg/L)	Depth-Averaged SS
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	Surface	1	29.3	8.1	20.9	8.5	7.6	5.0	8.5	5.4	6.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	Surface	2	29.4	8.2	20.7	8.5		5.7		6.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	Middle	1	28.9	8.0	22.2	6.7		5.8		6.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	Middle	2	29.0	8.1	21.9	6.7	5.8	6.2	8.5	5.9	6.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	Bottom	1	28.5	8.0	24.8	5.8		14.1		7.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)5	18:48	Bottom	2	28.7	8.0	24.6	5.8	6.6	14.3	10.1	7.3	5.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	Surface	1	30.2	8.1	12.2	6.7		10.1		3.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	Surface	2	30.2	8.1	12.0	6.9		9.0		4.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	Middle	1	30.0	8.0	15.6	6.3	6.3	11.5	10.1	5.9	5.5
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	Middle	2	30.0	8.0	15.5	6.4		10.3		4.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	Bottom	1	29.7	8.0	16.9	6.2	8.6	10.3	13.7	6.4	16.0
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	CS(Mf)3(N)	17:35	Bottom	2	29.7	8.0	16.6	6.4		9.6		7.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	Surface	1	29.3	8.1	20.8	8.6	8.6	10.9	13.7	16.1	16.0
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	Surface	2	29.5	8.2	20.6	8.6		10.3		15.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	Middle	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	Middle	2					8.6		13.7		16.0
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	Bottom	1	29.4	8.1	21.0	8.6		16.9		16.0	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)16	18:20	Bottom	2	29.5	8.2	20.8	8.6	9.2	16.8	16.6	16.1	35.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	Surface	1	29.6	8.1	20.1	9.1		13.1		35.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	Surface	2	29.7	8.2	19.9	9.2		13.9		34.3	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	Middle	1					8.5		16.6		35.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	Middle	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	Bottom	1	29.4	8.1	20.3	8.5	8.9	19.8	14.4	37.6	14.9
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4a	18:09	Bottom	2	29.5	8.2	20.1	8.5		19.7		35.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	Surface	1	29.5	8.1	20.4	8.9		10.8		13.9	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	Surface	2	29.6	8.2	20.2	8.9	8.9	11.0	14.4	15.4	14.9
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	Middle	1									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	Middle	2					8.1		16.9		17.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	Bottom	1	29.4	8.1	21.4	8.1		18.0		14.6	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	SR4(N)	18:05	Bottom	2	29.5	8.2	21.1	8.1	17.7	15.6			
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	Surface	1	29.5	8.1	20.5	8.9	8.9	14.4	16.9	16.6	17.7
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	Surface	2	29.6	8.2	20.3	8.9		15.8		17.5	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	Middle	1					6.7		17.5		19.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	Middle	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	Bottom	1	29.1	8.0	22.4	6.7	8.7	18.8	17.5	18.1	19.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS8	17:58	Bottom	2	29.2	8.0	22.1	6.7		18.5		18.5	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	Surface	1					8.7		17.5		19.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	Surface	2									
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	Middle	1	29.5	8.1	21.2	8.7	8.7	17.5	17.5	19.8	19.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	Middle	2	29.7	8.2	21.0	8.7		17.4		18.7	
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	Bottom	1					8.7		17.5		19.3
TMCLKL	HY/2012/07	2018-07-25	Mid-Flood	IS(Mf)9	17:48	Bottom	2									

Note: Indicates Exceedance of Action Level  
Indicates Exceedance of Limit Level

Photo 1 - Mid-Flood at SR4(a) on 25 July 2018





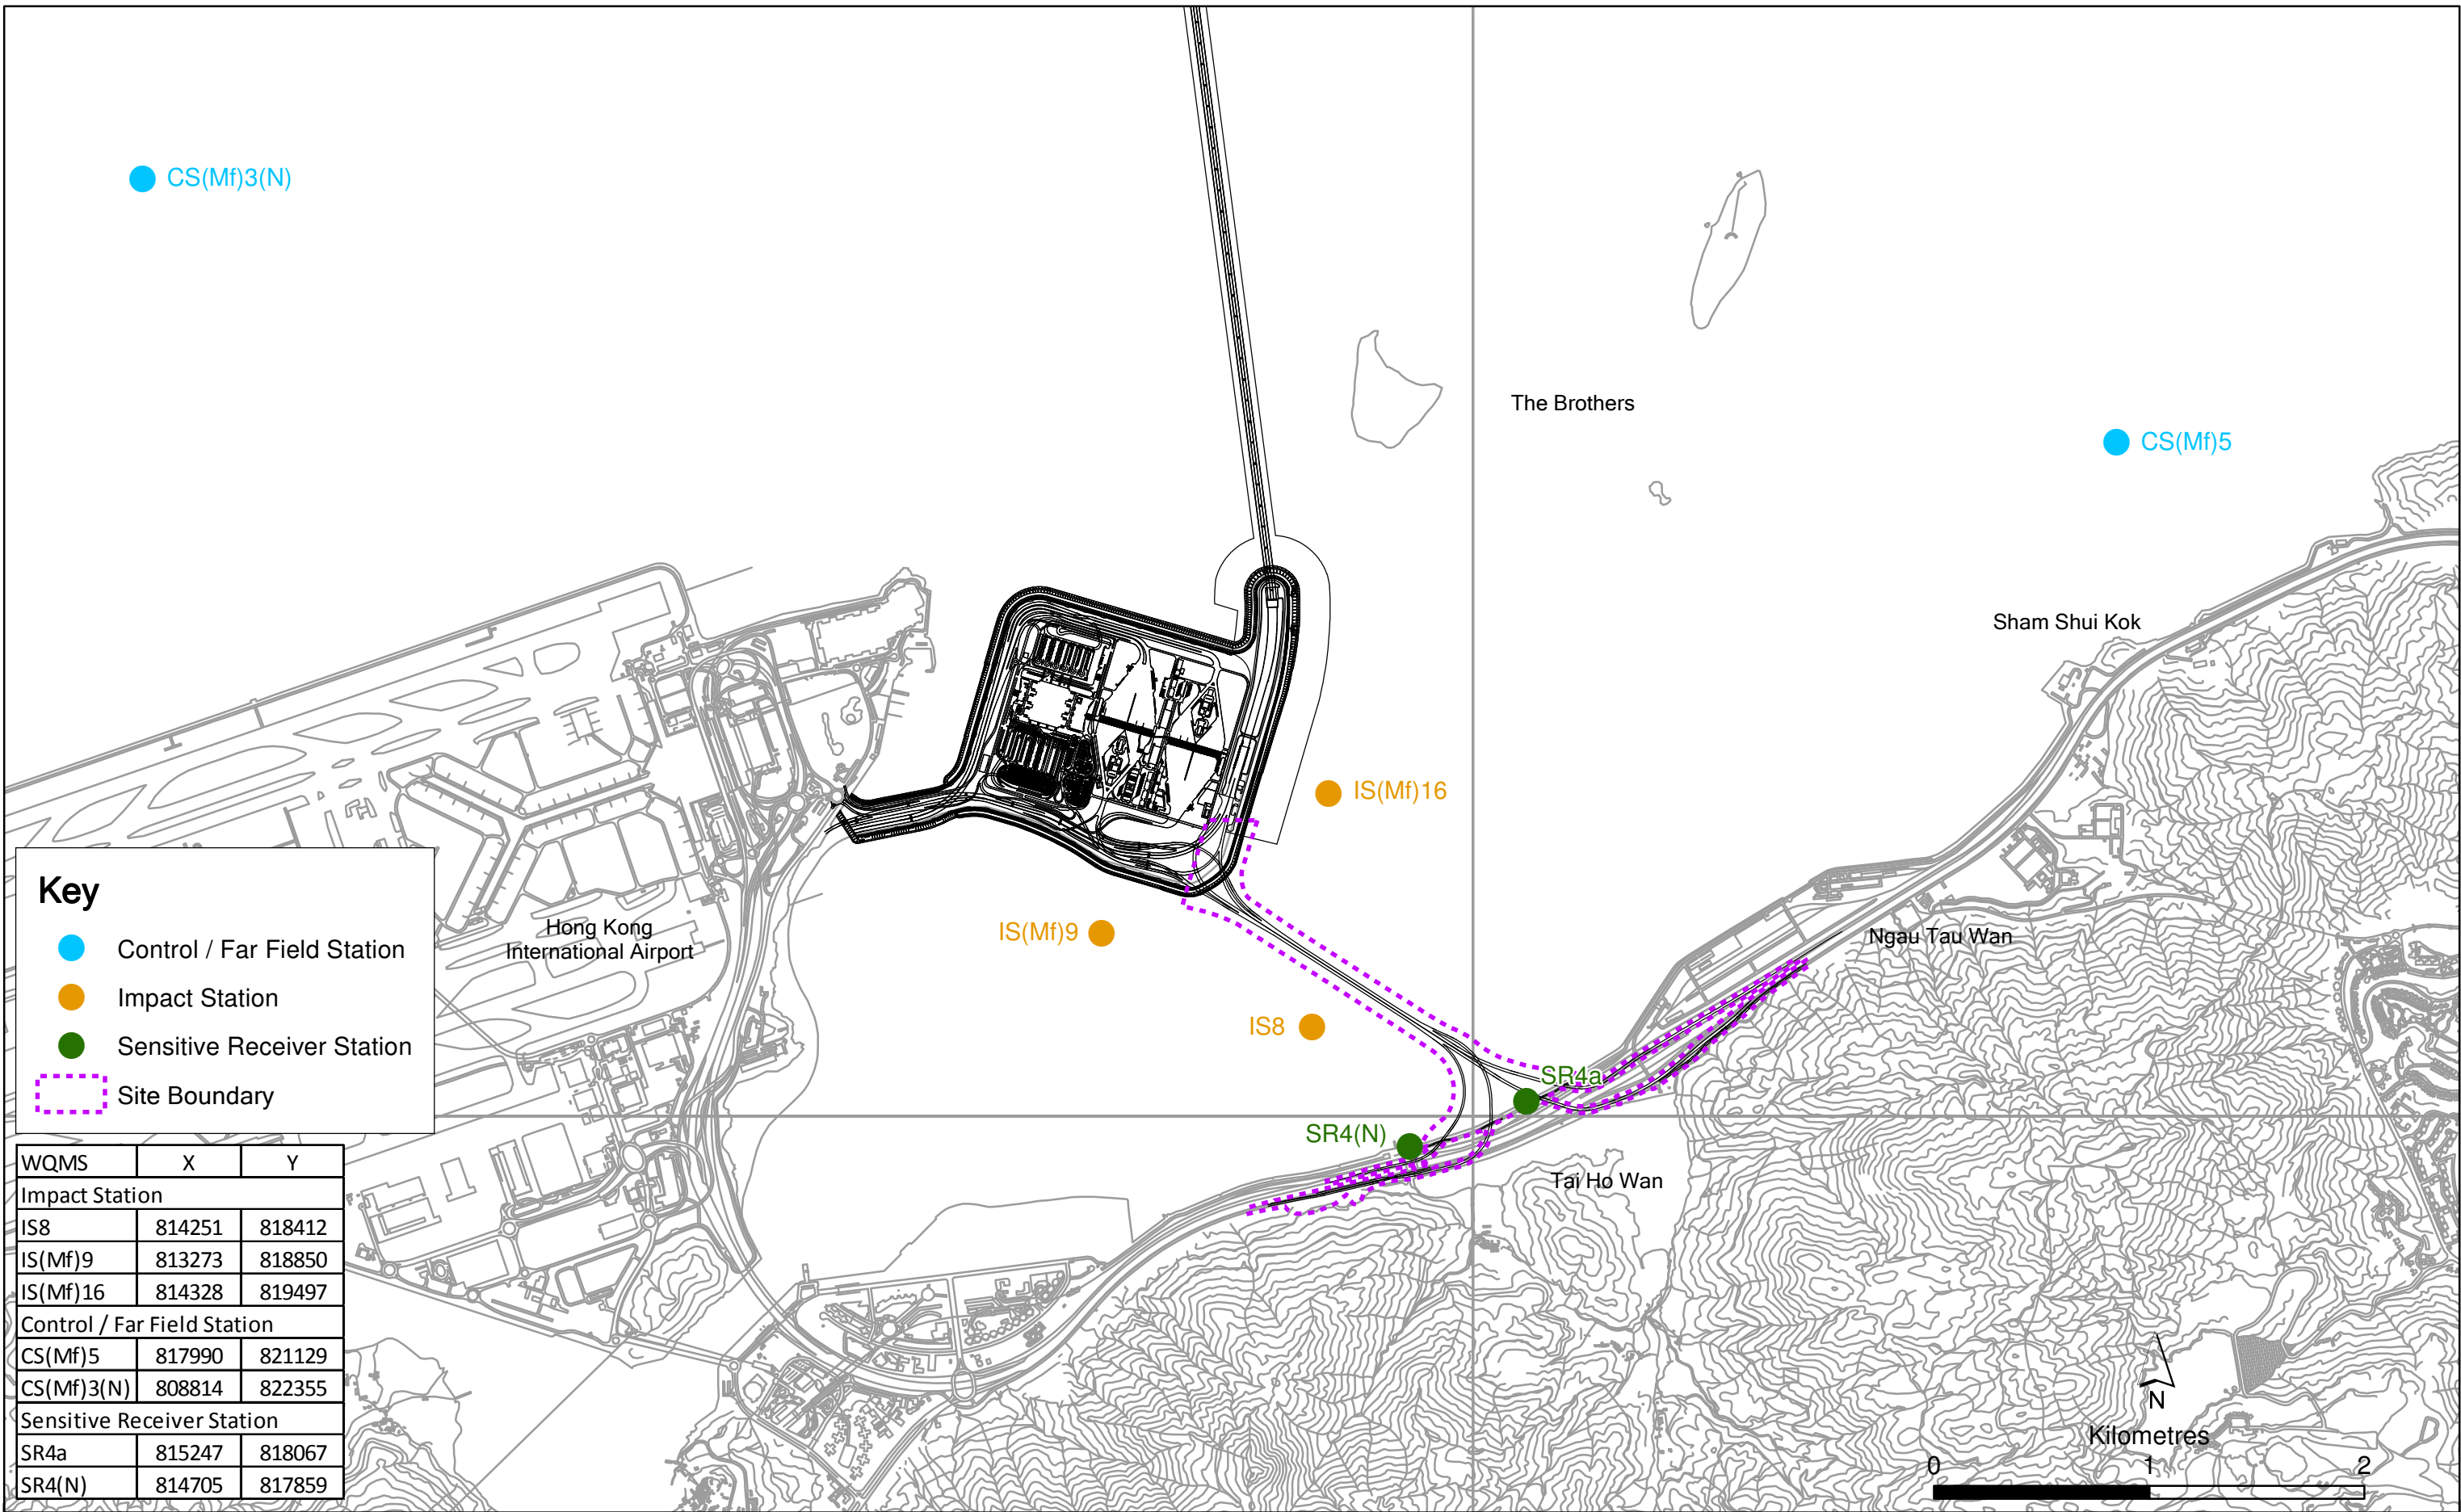

**Key**

- Control / Far Field Station
- Impact Station
- Sensitive Receiver Station
- Site Boundary

WQMS	X	Y
<b>Impact Station</b>		
IS8	814251	818412
IS(Mf)9	813273	818850
IS(Mf)16	814328	819497
<b>Control / Far Field Station</b>		
CS(Mf)5	817990	821129
CS(Mf)3(N)	808814	822355
<b>Sensitive Receiver Station</b>		
SR4a	815247	818067
SR4(N)	814705	817859

Locations of Water Quality Monitoring Stations

File: T:\GIS\CONTRACT\0215660\Mxd\0215660\_WQMS.mxd  
Date: 20/3/2018



**ENVIRONMENTAL COMPLAINT/ ENQUIRY FORM**

<b>Complaint/ Enquiry Received*</b>
Date: 16 June 2018 Time: Undisclosed From: 1823 Via: Email
Complainant/ <del>Enquirer</del> *: Name: Undisclosed Tel: Undisclosed Address: Undisclosed Media: <del>Dust</del> / Noise / <del>Water Quality</del> / <del>Other</del> Description: A complaint case was received on 16 June 2018 regarding road construction noise nuisance nearby the Kowloon-bound lane of the North Lantau Highway. The complainant lived in Tower 11 of Caribbean Coast. The complainant added the road construction works undertaken nearby have caused noise nuisance over half year. The complainant enquired the completion period of the relevant construction works and any mitigation measures to lower the noise nuisance caused by the construction works. The Environmental Team (ET) received the complaint notification from the Supervising Officer's Representative (SOR) on 27 June 2018.

***Investigation Report & Response***

<p>Construction Noise Permit (CNP) for night-time works (CNP no. GW-RS0462-18) and work records were reviewed immediately upon receiving the complaint. According to the work records provided by the Contractor, construction works nearby the Kowloon-bound lane of the North Lantau Highway under this Contract included temporary traffic arrangement in vicinity of Tai Ho Wan for installation of sign gantries (<i>Figure 1</i>). Relevant construction works commenced on 26 April 2018. As informed by the Contractor, quiet powered mechanical equipment (QPME) was deployed for night-time works during the concerned period. It is considered that the Contractor has complied with the corresponding conditions outlined in the CNP no. GW-RS0462-18. No non-compliance was identified.</p> <p>Other concurrent contracts (other than this Contract) in the past six months were examined. According to the information provided by Highways Department, works nearby Caribbean Coast included Contract No. 03/HY/2015 and DC/2016/01 which involved road maintenance works in vicinity of Siu Ho Wan and construction of additional sewage rising main between Tung Chung and Siu Ho Wan, respectively. In view of other concurrent contracts nearby and the large distance between the work area under this Contract and Caribbean Coast (over 500m), we considered that noise source from works under this Contract was not dominant in comparison with those two adjacent projects mentioned above.</p> <p>In addition, Impact Noise Monitoring results between 25 April 2018 and 21 June 2018 were reviewed (<i>refer below</i>). No exceedance on noise monitoring was recorded. The recorded levels of noise level on 25 April 2018 and 21 June 2018 were well below the Limit Level of the corresponding construction noise level (75 dB(A) for 0700-1900 hours on normal weekdays) (<i>refer to Noise Monitoring results below</i>).</p> <p>Based on the above, this complaint was considered not related to this Contract.</p> <p>Nevertheless, the Contractor has been reminded to lower communication voice between workers during the construction works. Relevant construction works ended on 22 June 2018.</p>
--

*Mitigation Measures and Follow-Up Actions Recommended to Contractor*

The Contractor has been reminded to strictly comply with all conditions stipulated in the CNP undertaken during restricted hours.

Date of File Closed : 09 July 2018

Approved and Filed by:



(Jovy Tam, ET Leader)

Date: 09 July 2018

## HY/2012/07 Noise Monitoring

Project	Works	Date (yyyy-mm-dd)	Station	Time (hh:mm, 24hour)	Parameter	Results	Unit
TMCLKL	HY/2012/07	2018-04-25	NSR1A	13:45	Leq 30 min	63	dB(A)
TMCLKL	HY/2012/07	2018-04-28	NSR1A	9:31	Leq 30 min	64	dB(A)
TMCLKL	HY/2012/07	2018-05-04	NSR1A	9:32	Leq 30 min	64	dB(A)
TMCLKL	HY/2012/07	2018-05-10	NSR1A	10:04	Leq 30 min	64	dB(A)
TMCLKL	HY/2012/07	2018-05-16	NSR1A	10:25	Leq 30 min	63	dB(A)
TMCLKL	HY/2012/07	2018-05-19	NSR1A	9:29	Leq 30 min	64	dB(A)
TMCLKL	HY/2012/07	2018-05-25	NSR1A	9:30	Leq 30 min	62	dB(A)
TMCLKL	HY/2012/07	2018-05-31	NSR1A	9:54	Leq 30 min	62	dB(A)
TMCLKL	HY/2012/07	2018-06-06	NSR1A	10:33	Leq 30 min	63	dB(A)
TMCLKL	HY/2012/07	2018-06-12	NSR1A	10:15	Leq 30 min	62	dB(A)
TMCLKL	HY/2012/07	2018-06-15	NSR1A	9:25	Leq 30 min	69	dB(A)
TMCLKL	HY/2012/07	2018-06-21	NSR1A	10:00	Leq 30 min	63	dB(A)

