

JOB NO.: TCS00694/13

AGREEMENT NO. CE 45/2008 (CE) LIANTANG/HEUNG YUEN WAI BOUNDARY CONTROL POINT AND ASSOCIATED WORKS

MONTHLY ENVIRONMENTAL MONITORING AND AUDIT REPORT (No.42) – JANUARY 2017

PREPARED FOR
CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT
(CEDD)

Date Reference No. Prepared By Certified By

13 February 2017 TCS00694/13/600/R0846v2

Nicola Hon Tam Tak Wing (Environmental Consultant) (Environmental Team Leader)

| Version | Date | Remarks |
|---------|------------------|--|
| 1 | 8 February 2017 | First Submission |
| 2 | 13 February 2017 | Amended against the IEC's comments on 10 February 2017 |
| | | |



Unit A-C, 27/F Ford Glory Plaza 37- 39 Wing Hong Street Cheung Sha Wan, Kowloon, Hong Kong T+852 3995 8100 F+852 3995 8101 E hongkong@smec.com www.smec.com

14 February 2017

Our ref: 7076192/L21476/AB/AW/MC/rw

AECOM 8/F, Grand Central Plaza, Tower 2 138 Shatin Rural Committee Road Shatin, N.T.

By Email & Post

Attention: Mr Simon LEUNG

Dear Sirs

Agreement No. CE 45/2008 (CE)
Liantang/Heung Yuen Wai Boundary Control Point and Associated Works
Independent Environmental Checker – Investigation
Monthly EM&A Report (No. 42) – January 2017

With reference to the Monthly EM&A Report No. 42 for January 2017 (Version 2) certified by the ET Leader, please be noted that we have no adverse comments on the captioned submission. We herewith verify the captioned submission in accordance with Condition 5.4 of the Environmental Permit No. EP-404/2011/D.

Thank you for your attention and please do not hesitate to contact the undersigned on tel. 3995-8120 or by email to antony.wong@smec.com; or our Mr Man CHEUNG on tel. 3995 8132 or by email to man.cheung@smec.com.

Yours faithfully for and on behalf of SMEC Asia Limited

Antony WONG

Independent Environmental Checker

CEDD/BCP CC Mr Desmond LAM by fax: 3547 1659 ArchSD Mr William WL CHENG by fax: 2804 6805 AECOM Mr Pat LAM / Mr Perry YAM by email Ronald Lu Mr Peter YAM / Mr Justin CHEUNG by email CW Mr Daniel HO by email DHK Mr Daniel ALTIER by email CCKJV Mr Vincent CHAN by email KRSJV Mr TY LEUNG by email Leighton Mr Jon KITCHING by email **AUES** Mr TW TAM by email





EXECUTIVE SUMMARY

ES01 This is the **42**nd monthly EM&A report presenting the monitoring results and inspection findings for the reporting period from **1 to 31 January 2017** (hereinafter 'the Reporting Period').

ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES

- ES02 To facilitate the project management and implementation, Liantang/Heung Yuen Wai Boundary Control Point and Associated Works of the Project is divided to seven CEDD contracts including Contract 2 (CV/2012/08), Contract 3 (CV/2012/09), Contract 4 (TCSS), Contract 5 (CV/2013/03), Contract 6 (CV/2013/08) and Contract 7 (NE/2014/03) and an ArshSD contract (Contract SS C505).
- ES03 In the Reporting Period, the major construction works under Liantang/Heung Yuen Wai Boundary Control Point and Associated Works of the Project included Contract 2, Contract 3, Contract 6, Contract 7 and Contract SS C505. Environmental monitoring activities under the EM&A programme in the Reporting Period are summarized in the following table.

| Environmental | Environmental Monitoring | Reporting 1 | Period |
|-----------------------|--|--|------------------------|
| Aspect | Parameters / Inspection | Number of Monitoring Locations to undertake | Total Occasions |
| Air Ovolity | 1-hour TSP | 9 | 135 |
| Air Quality | 24-hour TSP | 9 | 45 |
| Construction Noise | L _{eq(30min)} Daytime | 10 | 40 |
| | | WM1 & WM1-C | 12 Scheduled & 0 extra |
| | W/-4 in -i4 | WM2A(a) & WM2A-Cx | 12 Scheduled & 0 extra |
| Water Quality | Water in-situ measurement and/or sampling | WM2B & WM2B-C | 12 Scheduled & 0 extra |
| | and/or sampring | WM3x &WM3-C | 12 Scheduled & 0 extra |
| | | WM4, WM4-CA &WM4-CB | 12 Scheduled & 1 extra |
| Ecology | Woodland compensationi) General Health condition of planted speciesii) Survival of planted species | 9 Quadrats | 0 |
| | | Contract 2 | 4 |
| Joint Site | IEC, ET, the Contractor and | Contract 3 | 4 |
| Inspection / | RE joint site Environmental | Contract 6 | 4 |
| Audit | Inspection and Auditing | Contract 7 | 4 |
| | | Contract SS C505 | 4 |

Note: Extra monitoring day was due to measurement results exceedance

ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE

ES04 In the Reporting Period, no air quality and construction noise exceedances were recorded. For water quality monitoring, a total of two (2) Limit Level exceedances were recorded. The summary of exceedance in the Reporting Period is shown below.

| | | | | Event & Action | | | |
|-------------------------|-----------------------------------|-----------------|----------------|----------------|-------------------------|----------------------------------|-----------------------|
| Environmental Aspect | Monitoring Parameters | Action Level | Limit Level | NOE Issued | Investigation Result | Project related exceedance | Corrective Actions |
| Air Quality | 1-hour TSP | 0 | 0 | 0 | | | |
| 7 in Quanty | 24-hour TSP | 0 | 0 | 0 | | | |
| Construction Noise | L _{eq(30min)} Daytime | 0 | 0 | 0 | | | |
| Water Quality | DO | 0 | 0 | 0 | - | | |



| | | | | | Event of | & Action | |
|-------------------------|-------------------------|---|-------|---|-------------------------|----------------------------------|---|
| Environmental Aspect | Action Parameters Level | | 1 I N | | Investigation Result | Project related exceedance | Corrective Actions |
| | Turbidity | 0 | 1 | 1 | - All NOEs were | 0 | The Contractors were reminded to implement water quality mitigation |
| | SS | 0 | 1 | 1 | non-project related | 0 | measures in accordance with ISEMM of the EM&A Manual requirements |

ENVIRONMENTAL COMPLAINT

ES05 In this Reporting Period, a total of three (3) documented environmental complaints were received all regarding to water quality aspect, in which two (2) complaints were related to Contract 2 and the other one was related to both Contracts 2 and 6. The summary of complaint received in the Reporting Period is summarized below.

| | | Environmental Complaint | | | |
|------------------|-------------|-------------------------|-------------------|---------------------------|--|
| Reporting Period | Contract No | Frequency | Complaint Nature | Project related complaint | |
| | Contract 2 | 3 (*) | Water quality (2) | 1 (#) | |
| | Contract 3 | 0 | NA | NA | |
| 1 – 31 Jan 2017 | Contract 6 | 1 (*) | Water quality (1) | 0 | |
| | Contract 7 | 0 | NA | NA | |
| | SS C505 | 0 | NA | NA | |

Remark (#): One (1) environmental complaint in the reporting report is under investigation. (*): One complaint is related to both Contracts 2 and 6.

NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

ES06 No environmental summons or successful prosecutions were recorded in the Reporting Period.

REPORTING CHANGE

ES07 In the Reporting period, no reporting changes were made.

SITE INSPECTION

- ES08 In this Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract 2* has been carried out by the RE, IEC, ET and the Contractor on **6, 13, 20 and 27 January 2017**. No non-compliance was noted during the site inspection.
- ES09 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract 3* has been carried out by the RE, IEC, ET and the Contractor on 3, 9, 18 and 23 January 2017. No non-compliance was noted during the site inspection.
- ES10 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract 6* has been carried out by the RE, IEC, ET and the Contractor on **5**, **12**, **19** and **26 January 2017.** No non-compliance was noted during the site inspection.
- ES11 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract SS C505* has been carried out by the RE, IEC, ET and the Contractor on **5**, **11**, **18** and **23 January 2017**. No non-compliance was noted during the site inspection.



ES12 In the Reporting Period, joint site inspection to evaluate the site environmental performance at *Contract* 7 has been carried out by the RE, IEC, ET and the Contractor on 3, 10, 17 and 24 January 2017. No non-compliance was noted during the site inspection.

FUTURE KEY ISSUES

- ES13 During dry season, special attention should be paid on the potential construction dust impact since most of the construction sites are adjacent to villages. The Contractor should fully implement the construction dust mitigation measures.
- ES14 Preventive measures for muddy water or other water pollutants from site surface flow to local stream such as Kong Yiu Channel, Ma Wat Channel, Ping Yuen River or public area should be properly maintained. The Contractors should paid special attention on water quality mitigation measures and fully implement according ISEMM of the EM&A Manual, in particular for working areas near Ma Wat Channel and Ping Yuen River. Moreover, all effluent discharge shall be ensure to fulfill Technical Memorandum of Effluent Discharged into Drainage and Sewerage Systems, inland and Coastal Waters criteria or discharge permits stipulation.
- ES15 Construction noise would be a key environmental issue during construction work of the Project. Noise mitigation measures such as using quiet plants should be implemented in accordance with the EM&A requirement.



Table of Contents

| 1 | INTRODUCTION | 1 | | | | |
|-----|--|-------------|--|--|--|--|
| | 1.1 PROJECT BACKGROUND | 1 | | | | |
| | 1.2 REPORT STRUCTURE | 1 | | | | |
| 2 | PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS | 3 | | | | |
| _ | 2.1 CONSTRUCTION CONTRACT PACKAGING | 3 | | | | |
| | 2.2 PROJECT ORGANIZATION | 3 5 7 | | | | |
| | 2.3 CONCURRENT PROJECTS | 7 | | | | |
| | 2.4 CONSTRUCTION PROGRESS | 7 | | | | |
| | 2.5 SUMMARY OF ENVIRONMENTAL SUBMISSIONS | 9 | | | | |
| • | | | | | | |
| 3 | SUMMARY OF IMPACT MONITORING REQUIREMENTS | 14 | | | | |
| | 3.1 GENERAL | 14 | | | | |
| | 3.2 MONITORING PARAMETERS | 14 | | | | |
| | 3.3 MONITORING LOCATIONS 3.4 MONITORING EDITIONS DEPLOY | 14 | | | | |
| | 3.4 MONITORING FREQUENCY AND PERIOD 3.5 MONITORING FOLLOWING | 16 | | | | |
| | 3.5 MONITORING EQUIPMENT 3.6 MONITORING METHODOLOGY | 17 19 | | | | |
| | 3.6 MONITORING METHODOLOGY3.7 EQUIPMENT CALIBRATION | 21 | | | | |
| | 3.7 EQUIPMENT CALIBRATION 3.8 DERIVATION OF ACTION/LIMIT (A/L) LEVELS | 21 | | | | |
| | 3.9 DATA MANAGEMENT AND DATA QA/QC CONTROL | 22 | | | | |
| | | | | | | |
| 4 | AIR QUALITY MONITORING | 23 | | | | |
| | 4.1 GENERAL | 23 | | | | |
| | 4.2 AIR QUALITY MONITORING RESULTS | 23 | | | | |
| 5 | CONSTRUCTION NOISE MONITORING | | | | | |
| | 5.1 GENERAL | 26 | | | | |
| | 5.2 NOISE MONITORING RESULTS (NORMAL DAYTIME) | 26 | | | | |
| | 5.3 Noise Monitoring Results (Restricted Hours) | 26 | | | | |
| 6 | WATER QUALITY MONITORING | 28 | | | | |
| Ū | 6.1 GENERAL | 28 | | | | |
| | 6.2 RESULTS OF WATER QUALITY MONITORING | 28 | | | | |
| _ | | | | | | |
| 7 | ECOLOGY MONITORING | 31 | | | | |
| | 7.1 GENERAL | 31 | | | | |
| 8 | WASTE MANAGEMENT | 32 | | | | |
| | 8.1 GENERAL WASTE MANAGEMENT | 32 | | | | |
| | 8.2 RECORDS OF WASTE QUANTITIES | 32 | | | | |
| 9 | SITE INSPECTION | 33 | | | | |
| | 9.1 REQUIREMENTS | 33 | | | | |
| | 9.2 FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH | 33 | | | | |
| 4.0 | | | | | | |
| 10 | ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE | 37 | | | | |
| | 10.1 Environmental Complaint, Summons and Prosecution | 37 | | | | |
| 11 | IMPLEMENTATION STATUS OF MITIGATION MEASURES | 42 | | | | |
| | 11.1 GENERAL REQUIREMENTS | 42 | | | | |
| | 11.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH | 42 | | | | |
| | 11.3 KEY ISSUES FOR THE COMING MONTH | 44 | | | | |
| 12 | CONCLUSIONS AND RECOMMENDATIONS | 45 | | | | |
| _ | 12.1 CONCLUSIONS | 45 | | | | |
| | 12.2 RECOMMENDATIONS | 45 | | | | |



LIST OF TABLES

| Table 3-1 | SUMMARY OF EM&A REQUIREMENTS |
|------------|--|
| TABLE 3-2 | IMPACT MONITORING STATIONS - AIR QUALITY |
| TABLE 3-3 | IMPACT MONITORING STATIONS - CONSTRUCTION NOISE |
| TABLE 3-4 | IMPACT MONITORING STATIONS - WATER QUALITY |
| TABLE 3-5 | AIR QUALITY MONITORING EQUIPMENT |
| Table 3-6 | CONSTRUCTION NOISE MONITORING EQUIPMENT |
| TABLE 3-7 | WATER QUALITY MONITORING EQUIPMENT |
| TABLE 3-8 | ACTION AND LIMIT LEVELS FOR AIR QUALITY MONITORING |
| TABLE 3-9 | ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE |
| TABLE 3-10 | ACTION AND LIMIT LEVELS FOR WATER QUALITY |
| TABLE 4-1 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM1A |
| TABLE 4-2 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM2 |
| TABLE 4-3 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM3 |
| TABLE 4-4 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM4B |
| TABLE 4-5 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM5A |
| TABLE 4-6 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM6 |
| TABLE 4-7 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM7A |
| TABLE 4-8 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM8 |
| TABLE 4-9 | SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM9B |
| TABLE 5-1 | SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS |
| TABLE 5-2 | SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS |
| TABLE 5-3 | SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS (EVENING TIME) |
| TABLE 5-4 | SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS (NIGHT TIME) |
| TABLE 6-1 | SUMMARY OF WATER QUALITY MONITORING RESULTS FOR CONTRACT 2 AND 3 |
| TABLE 6-2 | Summary of Water Quality Monitoring Results for Contract 5 and SS C505 $$ |
| TABLE 6-3 | SUMMARY OF WATER QUALITY MONITORING RESULTS FOR CONTRACT 6 |
| TABLE 6-4 | SUMMARY OF WATER QUALITY MONITORING RESULTS FOR CONTRACT 2 AND 6 |
| TABLE 6-5 | ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE RECORDED |
| TABLE 6-6 | SUMMARY OF WATER QUALITY EXCEEDANCE IN THE REPORTING PERIOD |
| TABLE 6-7 | SUMMARY OF WATER QUALITY EXCEEDANCE WHICH WERE UNDER REVIEW BY IEC IN APRIL 2016 |
| TABLE 8-1 | SUMMARY OF QUANTITIES OF INERT C&D MATERIALS |
| TABLE 8-2 | SUMMARY OF QUANTITIES OF C&D WASTES |
| TABLE 9-1 | SITE OBSERVATIONS FOR CONTRACT 2 |
| TABLE 9-2 | SITE OBSERVATIONS FOR CONTRACT 3 |
| TABLE 9-3 | SITE OBSERVATIONS FOR CONTRACT 5 |
| Table 9-4 | SITE OBSERVATIONS FOR CONTRACT 6 |
| TABLE 9-5 | SITE OBSERVATIONS FOR CONTRACT SS C505 |
| Table 9-6 | SITE OBSERVATIONS FOR CONTRACT 7 |
| TABLE 10-1 | STATISTICAL SUMMARY OF ENVIRONMENTAL COMPLAINTS |
| TABLE 10-2 | STATISTICAL SUMMARY OF ENVIRONMENTAL SUMMONS |
| TABLE 10-3 | STATISTICAL SUMMARY OF ENVIRONMENTAL PROSECUTION |
| TABLE 11-1 | ENVIRONMENTAL MITIGATION MEASURES |



LIST OF APPENDICES

| LAYOUT PLAN OF THE PROJECT |
|--|
| ORGANIZATION CHART |
| 3-MONTH ROLLING CONSTRUCTION PROGRAM |
| DESIGNATED MONITORING LOCATIONS AS RECOMMENDED IN THE APPROVED EM&A MANUAL |
| MONITORING LOCATIONS FOR IMPACT MONITORING |
| CALIBRATION CERTIFICATE OF MONITORING EQUIPMENT AND |
| HOKLAS-ACCREDITATION CERTIFICATE OF THE TESTING LABORATORY |
| EVENT AND ACTION PLAN |
| IMPACT MONITORING SCHEDULE |
| DATABASE OF MONITORING RESULT |
| GRAPHICAL PLOTS FOR MONITORING RESULT |
| METEOROLOGICAL DATA |
| WASTE FLOW TABLE |
| IMPLEMENTATION SCHEDULE FOR ENVIRONMENTAL MITIGATION MEASURES |
| INVESTIGATION REPORT FOR EXCEEDANCE |
| |



1 INTRODUCTION

1.1 PROJECT BACKGROUND

- 1.1.1 Civil Engineering and Development Department is the Project Proponent and the Permit Holder of Agreement No. CE 45/2008 (CE) Liantang / Heung Yuen Wai Boundary Control Point and Associated Works, which is a Designated Project to be implemented under Environmental Permit number EP-404/2011/C granted on 12 March 2015 and the latest Environmental Permit number EP-404/2011/D granted on 20 January 2017.
- 1.1.2 The Project consists of two main components: Construction of a Boundary Control Point (hereinafter referred as "BCP"); and Construction of a connecting road alignment. Layout plan of the Project is shown in *Appendix A*.
- 1.1.3 The proposed BCP is located at the boundary with Shenzhen near the existing Chuk Yuen Village, comprising a main passenger building with passenger and cargo processing facilities and the associated customs, transport and ancillary facilities. The connecting road alignment consists of six main sections:
 - 1) Lin Ma Hang to Frontier Closed Area (FCA) Boundary this section comprises at-grade and viaducts and includes the improvement works at Lin Ma Hang Road;
 - 2) Ping Yeung to Wo Keng Shan this section stretches from the Frontier Closed Area Boundary to the tunnel portal at Cheung Shan and comprises at-grade and viaducts including an interchange at Ping Yeung;
 - 3) North Tunnel this section comprises the tunnel segment at Cheung Shan and includes a ventilation building at the portals on either end of the tunnel;
 - 4) Sha Tau Kok Road this section stretches from the tunnel portal at Wo Keng Shan to the tunnel portal south of Loi Tung and comprises at-grade and viaducts including an interchange at Sha Tau Kok and an administration building;
 - 5) South Tunnel this section comprises a tunnel segment that stretches from Loi Tung to Fanling and includes a ventilation building at the portals on either end of the tunnel as well as a ventilation building in the middle of the tunnel near Lau Shui Heung;
 - 6) Fanling this section comprises the at-grade, viaducts and interchange connection to the existing Fanling Highway.
- 1.1.4 Action-United Environmental Services & Consulting has been commissioned as an Independent ET to implement the relevant EM&A program in accordance with the approved EM&A Manual, as well as the associated duties. As part of the EM&A program, the baseline monitoring has carried out between 13 June 2013 and 12 July 2013 for all parameters including air quality, noise and water quality before construction work commencement. The Baseline Monitoring Report summarized the key findings and the rationale behind determining a set of Action and Limit Levels (A/L Levels) from the baseline data. Also, the Project baseline monitoring report which verified by the IEC has been submitted to EPD on 16 July 2013 for endorsement. The major construction works of the Project was commenced on 16 August 2013 in accordance with the EP Section 5.3 stipulation.
- 1.1.5 This is 42nd monthly EM&A report presenting the monitoring results and inspection findings for reporting period from 1 to 31 January 2017.

1.2 REPORT STRUCTURE

- 1.2.1 The Monthly Environmental Monitoring and Audit (EM&A) Report is structured into the following sections:-
 - **Section 1** Introduction
 - Section 2 Project Organization and Construction Progress
 - **Section 3** Summary of Impact Monitoring Requirements
 - **Section 4** Air Quality Monitoring
 - Section 5 Construction Noise Monitoring



| Section 6 | Water Quality Monitoring |
|------------|--|
| Section 7 | Waste Management |
| Section 8 | Site Inspections |
| Section 9 | Environmental Complaints and Non-Compliance |
| Section 10 | Implementation Status of Mitigation Measures |
| Section 11 | Conclusions and Recommendations |



2 PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS

2.1 CONSTRUCTION CONTRACT PACKAGING

- 2.1.1 To facilitate the project management and implementation, the Project would be divided by the following contracts:
 - Contract 2 (CV/2012/08)
 - Contract 3 (CV/2012/09)
 - Contract 4 (NE/2014/02)
 - Contract 5 (CV/2013/03)
 - Contract 6 (CV/2013/08)
 - Contract 7 (NE/2014/03)
 - ArchSD Contract No. SS C505
- 2.1.2 The details of each contracts is summarized below and the delineation of each contracts is shown in *Appendix A*.

Contract 2 (CV/2012/08)

- 2.1.3 Contract 2 has awarded in December 2013 and construction work was commenced on 19 May 2014. Major Scope of Work of the Contract 2 is listed below:
 - construction of an approximately 5.2km long dual two-lane connecting road (with about 0.4km of at-grade road and 4.8km of tunnel) connecting the Fanling Interchange with the proposed Sha Tau Kok Interchange;
 - construction of a ventilation adit tunnel and the mid-ventilation building:
 - construction of the north and south portal buildings of the Lung Shan Tunnel and their associated slope works;
 - provision and installation of ventilation system, E&M works and building services works for Lung Shan tunnel and Cheung Shan tunnel and their portal buildings;
 - construction of Tunnel Administration Building adjacent to Wo Keng Shan Road and the associated E&M and building services works; and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 3 (CV/2012/09)

- 2.1.4 Contract 3 was awarded in July 2013 and construction work was commenced on 5 November 2013. Major Scope of Work of the Contract 3 is listed below:
 - construction of four link roads connecting the existing Fanling Highway and the south portal of the Lung Shan Tunnel;
 - realignment of the existing Tai Wo Service Road West and Tai Wo Service Road East;
 - widening of the existing Fanling Highway (HyD's entrustment works);
 - demolishing existing Kiu Tau vehicular bridge and Kiu Tau footbridge and reconstruction of the existing Kiu Tau Footbridge (HyD's entrustment works); and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 4 (NE/2014/02)

- 2.1.5 Contract 4 has awarded in mid-April 2016. However, the major construction work still is not yet commenced. The scope of work of the Contract 4 includes:
 - design, supply, delivery, installation, testing and commissioning of a traffic control and surveillance system for the connecting road linking up the Liantang / Heung Yuen Wai Boundary Control Point and the existing Fanling Highway.



Contract 5 (CV/2013/03)

- 2.1.6 Contract 5 has awarded in April 2013 and construction work was commenced in August 2013. Major Scope of Work of the Contract 5 is listed below:
 - site formation of about 23 hectares of land for the development of the BCP;
 - construction of an approximately 1.6 km long perimeter road at the BCP including a 175m long depressed road;
 - associated diversion/modification works at existing local roads and junctions including Lin Ma Hang Road;
 - construction of pedestrian subway linking the BCP to Lin Ma Hang Road;
 - provision of resite area with supporting infrastructure for reprovisioning of the affected village houses; and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 6 (CV/2013/08)

- 2.1.7 Contract 6 has awarded in June 2015 and construction work was commenced on 23 October 2015. Major Scope of Work of the Contract 6 would be included below:
 - construction of an approximately 4.6km long dual two-lane connecting road (with about 0.6km of at-grade road, 3.3km of viaduct and 0.7km of tunnel) connecting the BCP with the proposed Sha Tau Kok Road Interchange and the associated ventilation buildings;
 - associated diversion/modification works at access roads to the resite of Chuk Yuen Village;
 - provision of sewage collection, treatment and disposal facilities for the BCP and the resite of Chuk Yuen Village;
 - construction of a pedestrian subway linking the BCP to Lin Ma Hang Road;
 - provisioning of the affected facilities including Wo Keng Shan Road garden; and
 - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

Contract 7 (NE/2014/03)

- 2.1.8 Contract 7 has awarded in December 2015 and the construction works of Contract 7 was commenced on 15 February 2016. Major Scope of Work of the Contract 7 would be included below:
 - construction of the Hong Kong Special Administrative Region (HKSAR) portion of four vehicular bridge
 - construction of one pedestrian bridge crossing Shenzhen (SZ) River (cross boundary bridges)

ArchSD Contract No. SS C505

- 2.1.9 SS C505 has awarded in July 2015 and construction work was commenced on 1 September 2015. Major Scope of Work of the SS C505 would be included below:
 - passenger-related facilities including processing kiosks and examination facilities for private cars and coaches, passenger clearance building and halls, the interior fitting works for the pedestrian bridge crossing Shenzhen River, etc.;
 - cargo processing facilities including kiosks for clearance of goods vehicles, customs inspection platforms, X-ray building, etc.;
 - accommodation for the facilities inside of the Government departments providing services in connection with the BCP:
 - transport-related facilities inside the BCP including road networks, public transport interchange, transport drop-off and pick-up areas, vehicle holding areas and associated road furniture etc;
 - a public carpark; and



• other ancillary facilities such as sewerage and drainage, building services provisions and electronic systems, associated environmental mitigation measure and landscape works.

2.2 PROJECT ORGANIZATION

2.2.1 The project organization is shown in *Appendix B*. The responsibilities of respective parties are:

Civil Engineering and Development Department (CEDD)

2.2.2 CEDD is the Project Proponent and the Permit Holder of the EP of the development of the Project and will assume overall responsibility for the project. An Independent Environmental Checker (IEC) shall be employed by CEDD to audit the results of the EM&A works carried out by the ET.

<u>Architectural Services Department (ArchSD)</u>

2.2.3 ArchSD acts as the works agent for Development Bureau (DEVB), for Contract SS C505 Liantang/ Heung Yuen Wai Boundary Control Point (BCP) – BCP Buildings and Associated Facilities

Environmental Protection Department (EPD)

2.2.4 EPD is the statutory enforcement body for environmental protection matters in Hong Kong.

Ronald Lu & Partners (Hong Kong) Ltd (The Architect)

- 2.2.5 Ronald Lu & Partners (Hong Kong) Ltd is appointed by ArchSD as an Architect for Contract SS C505 Liantang/ Heung Yuen Wai Boundary Control Point (BCP) BCP Buildings and Associated Facilities. It responsible for overseeing the construction works of Contract SS C505 and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the Architect with respect to EM&A are:
 - Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
 - Monitor Contractors' and ET's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
 - Facilitate ET's implementation of the EM&A programme
 - Participate in joint site inspection by the ET and IEC
 - Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance
 - Adhere to the procedures for carrying out complaint investigation
 - Liaison with DSD, Engineer/Engineer's Representative, ET, IEC and the Contractor of the "Construction of the DSD's Regulation of Shenzhen River Stage 4 (RSR 4)" Project discussing regarding the cumulative impact issues.

Engineer or Engineers Representative (ER)

- 2.2.6 The ER is responsible for overseeing the construction works and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the ER with respect to EM&A are:
 - Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
 - Monitor Contractors's, ET's and IEC's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
 - Facilitate ET's implementation of the EM&A programme
 - Participate in joint site inspection by the ET and IEC
 - Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance



- Adhere to the procedures for carrying out complaint investigation
- Liaison with DSD, Engineer/Engineer's Representative, ET, IEC and the Contractor of the "Construction of the DSD's Regulaiton of Shenzhen River Stage 4 (RSR 4)" Project discussing regarding the cumulative impact issues.

The Contractor(s)

- 2.2.7 There will be one contractor for each individual works contract. Once the contractors are appointed, EPD, ET and IEC will be notified the details of the contractor.
- 2.2.8 The Contractor for Contracts under CEDD should report to the ER. For ArchSD Contract, the Contractor should report to the Architect or Architect's Representative (AR). The duties and responsibilities of the Contractor are:
 - Comply with the relevant contract conditions and specifications on environmental protection
 - Employ an Environmental Team (ET) to undertake monitoring, laboratory analysis and reporting of EM &A Facilitate ET's monitoring and site inspection activities
 - Participate in the site inspections by the ET and IEC, and undertake any corrective actions
 - Provide information / advice to the ET regarding works programme and activities which may contribute to the generation of adverse environmental impacts
 - Submit proposals on mitigation measures in case of exceedances of Action and Limit levels in accordance with the Event / Action Plans
 - Implement measures to reduce impact where Action and Limit levels are exceeded
 - Adhere to the procedures for carrying out complaint investigation

Environmental Team (ET)

- 2.2.9 Once the ET is appointed, the EPD, CEDD, ER, Architect and IEC will be notified the details of the ET.
- 2.2.10 The ET shall not be in any way an associated body of the Contractor(s), and shall be employed by the Project Proponent/Contractor to conduct the EM&A programme. The ET should be managed by the ET Leader. The ET Leader shall be a person who has at least 7 years' experience in EM&A and has relevant professional qualifications. Suitably qualified staff should be included in the ET, and resources for the implementation of the EM&A programme should be allocated in time under the Contract(s), to enable fulfillment of the Project's EM&A requirements as specified in the EM&A Manual during construction of the Project. The ET shall report to the Project Proponent and the duties shall include:
 - Monitor and audit various environmental parameters as required in this EM&A Manual
 - Analyse the environmental monitoring and audit data, review the success of EM&A programme and the adequacy of mitigation measures implemented, confirm the validity of the EIA predictions and identify any adverse environmental impacts arising
 - Carry out regular site inspection to investigate and audit the Contractors' site practice, equipment/plant and work methodologies with respect to pollution control and environmental mitigation, and effect proactive action to pre-empt problems
 - Monitor compliance with conditions in the EP, environmental protection, pollution prevention and control regulations and contract specifications
 - Audit environmental conditions on site
 - Report on the environmental monitoring and audit results to EPD, the ER, the Architect, the IEC and Contractor or their delegated representatives
 - Recommend suitable mitigation measures to the Contractor in the case of exceedance of Action and Limit levels in accordance with the Event and Action Plans
 - Liaise with the IEC on all environmental performance matters and timely submit all relevant EM&A proforma for approval by IEC
 - Advise the Contractor(s) on environmental improvement, awareness, enhancement measures etc., on site
 - Adhere to the procedures for carrying out complaint investigation



• Liaison with the client departments, Engineer/Engineer's Representative, ET, IEC and the Contractor(s) of the concurrent projects as listed under Section 2.3 below regarding the cumulative impact issues.

Independent Environmental Checker (IEC)

- 2.2.11 One IEC will be employed for this Project. Once the IEC is appointed, EPD, ER, the Architect and ET will be notified the details of the IEC.
- 2.2.12 The Independent Environmental Checker (IEC) should not be in any way an associated body of the Contractor or the ET for the Project. The IEC should be employed by the Permit Holder (i.e., CEDD) prior to the commencement of the construction of the Project. The IEC should have at least 10 years' experience in EM&A and have relevant professional qualifications. The appointment of IEC should be subject to the approval of EPD. The IEC should:
 - Provide proactive advice to the ER and the Project Proponent on EM&A matters related to the project, independent from the management of construction works, but empowered to audit the environmental performance of construction
 - Review and audit all aspects of the EM&A programme implemented by the ET
 - Review and verify the monitoring data and all submissions in connection with the EP and EM&A Manual submitted by the ET
 - Arrange and conduct regular, at least monthly site inspections of the works during construction phase, and ad hoc inspections if significant environmental problems are identified
 - Check compliance with the agreed Event / Action Plan in the event of any exceedance
 - Check compliance with the procedures for carrying out complaint investigation
 - Check the effectiveness of corrective measures
 - Feedback audit results to ET by signing off relevant EM&A proforma
 - Check that the mitigation measures are effectively implemented
 - Verify the log-book(s) mentioned in Condition 2.2 of the EP, notify the Director by fax, within one working day of receipt of notification from the ET Leader of each and every occurrence, change of circumstances or non-compliance with the EIA Report and/or the EP, which might affect the monitoring or control of adverse environmental impacts from the Project
 - Report the works conducted, the findings, recommendation and improvement of the site inspections, after reviewing ET's and Contractor's works, and advices to the ER and Project Proponent on a monthly basis
 - Liaison with the client departments, Engineer/Engineer's Representative, the Architect, ET, IEC and the Contractor of the concurrent projects as listed under Section 2.3 below regarding the cumulative impact issues.

2.3 CONCURRENT PROJECTS

- 2.3.1 The concurrent construction works that may be carried out include, but not limited to, the following:
 - (a) Regulation of Shenzhen River Stage IV;
 - (b) Widening of Fanling Highway Tai Hang to Wo Hop Shek Interchange Contract No. HY/2012/06;
 - (c) Construction of BCP facilities in Shenzhen.

2.4 CONSTRUCTION PROGRESS

2.4.1 In the Reporting Period, the major construction activity conducted under the Project is located in Contracts 2, 3, 6, 7 and SS C505 and they are summarized in below. Moreover, 3-month rolling construction program for all the current contracts is enclosed in *Appendix C*.



Contract 2 (CV/2012/08)

2.4.2 The contract commenced in May 2014. In this Reporting Period, construction activities conducted are listed below:

Mid-Vent

Portal

- Preparation for Tunnel Boring Machine (TBM) south drive break out
- Adit invert slab, waterproofing and lining
 - Connecting structure and ventilation building superstructure

North Portal • Slope stabilization and retaining wall

- Southbound Tunnel Boring Machine (TBM) excavation
- Construction of cross passage and internal structure
- Tunnel internal structure and cross passage
- ventilation building superstructure

South Portal • Southbound and northbound Drill & Blast Excavation

- South ventilation and building superstructure
- Tunnel invert, waterproofing and lining

Admin Building • Building superstructure and external wall

Contract 3 (CV/2012/09)

- 2.4.3 The Contract commenced in November 2013. In this Reporting Period, construction activities conducted are listed below:
 - Abutment construction
 - Construction of boundary wall for DSD pumping station
 - Cable detection and trial trenches
 - Demolition of existing Vehicular Bridge
 - Extended podium construction
 - Footbridge construction
 - Storm drains laying
 - Noise barrier construction
 - Pier / pier table construction
 - Portal beam construction
 - Construction of remaining base Slab of Box Culvert ID4
 - Retaining wall construction
 - Road works
 - Roundabout modification works
 - Sewer works
 - Utilities Duct Laying
 - Viaduct segment erection
 - Water Main Laying

Contract 4 (Contract number to be assigned)

2.4.4 The Contract was awarded in mid-April 2016 and the major construction work has not yet commenced.

Contract 5 (CV/2013/03)

2.4.5 As advised by the ER, the construction works under Contract 5 was substantially completed on 31 August 2016.

Contract 6 (CV/2013/08)

- 2.4.6 Contract 6 has awarded in June 2015 and construction work was commenced on 23 October 2015. In this Reporting Period, construction activities conducted are listed below:
 - Bored Piling
 - Pile Cap Construction



- Bridge Pier Construction
- Bridge Segment Erection
- Tunnel Excavation
- Sewage Treatment Plant Construction
- Road Construction

Contract 7 (NE/2014/03)

- 2.4.7 Contract 7 has awarded in December 2015 and construction work was commenced on 15 February 2016. In this Reporting Period, construction activities conducted are listed below:
 - Piling Works at Bridges A and E
 - Pile Caps Construction at Bridges A and E
 - Column construction at Bridge C
 - 2nd floor slab construction at Bridge C

Contract SS C505

- 2.4.8 Contract SS C505 has awarded in July 2015 and construction work was commenced on 1 September 2015. In this Reporting Period, construction activities conducted are listed below:
 - Building no.4, 5, 6, 7, 9, 10, 11 and 36 construction
 - Excavation for drainage works for Building no. 4 & 5
 - Pile cap construction for Building no. 7
 - Roof construction for Building no.36
 - Tower crane operation
 - Bridge construction works including construction of bridge column, retaining wall, pile cap and pier
 - Underground drainage works
 - Mock up for south entrance double curve cladding
 - Formwork and falsework for PTB's slab construction
 - Construction PTB M/F & 1/F flat slab
 - Steel beam works for maintenance platform for PTB
 - Pile cap construction for PTB, including excavation and backfilling works
 - Bridge deck construction for Bridges 1-5
 - Footing construction

2.5 SUMMARY OF ENVIRONMENTAL SUBMISSIONS

- 2.5.1 In according to the EP, the required documents have submitted to EPD which listed in below:
 - Project Layout Plans of Contracts 2, 3, 5, 6, 7 and SS C505
 - Landscape Plan
 - Topsoil Management Plan
 - Environmental Monitoring and Audit Programme
 - Baseline Monitoring Report (TCS00690/13/600/R0030v3) for the Project
 - Waste Management Plan of the Contracts 2, 3, 5, 6, 7 and SS C505
 - Contamination Assessment Plan (CAP) and Contamination Assessment Report (CAR) for Po Kat Tsai, Loi Tung and the workshops in Fanling
 - Vegetation Survey Report
 - Woodland Compensation Plan
 - Habitat Creation Management Plan
 - Wetland Compensation Plan
- 2.5.2 Summary of the relevant permits, licenses, and/or notifications on environmental protection for the Project of each contracts are presented in *Table 2-1*.



Table 2-1 Status of Environmental Licenses and Permits of the Contracts

| T. | D 1.41 | License/Permit Status | | | | |
|------|---|--|-----------------------|-----------------------|--|--|
| Item | Description | Ref. no. | Effective Date | Expiry Date | | |
| | | Contract 2 | | | | |
| 1 | Air pollution Control (Construction Dust) Regulation | Ref No.: 368864 | 31 Dec 2013 | Till Contract ends | | |
| 2 | Chemical Waste Producer Registration | North Portal Waste Producers Number: No.5213-652-D2523-01 | 25 Mar 2014 | Till Contract ends | | |
| | | Mid-Vent Portal Waste Producers Number: No.5213-634-D2524-01 | 25 Mar 2014 | Till Contract ends | | |
| | | South Portal Waste Producers Number: No.5213-634-D2526-01 | 9 Apr 2014 | Till Contract ends | | |
| 3 | Water Pollution | No.WT00018374-2014 | 8 Oct 2014 | 30 Sep 2019 | | |
| | Control Ordinance - | No.: W5/1I389 | 28 Mar 2014 | 31 Mar 2019 | | |
| | Discharge License | No. WT00023063-2015 | 18 Dec 2015 | 31 Mar 2019 | | |
| | | No.: W5/1I392 | 28 Mar 2014 | 31 Mar 2019 | | |
| 4 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Account No. 7019105 | 8 Jan 2014 | Till Contract ends | | |
| 5 | Construction Noise | GW-RN0543-16 | 18 Jul 2016 | 13 Jan 2017 | | |
| | Permit | GW-RN0579-16 | 11 Aug 2016 | 07 Jan 2017 | | |
| | | GW-RN0604-16 | 11 Aug 2016 | 07 Jan 2017 | | |
| | | GW-RN0695-16 | 18 Sep 2016 | 17 Mar 2017 | | |
| | | GW-RN0700-16 | 20 Sep 2016 | 19 Feb 2017 | | |
| | | GW-RN0759-16 | 12 Oct 2016 | 11 Apr 2017 | | |
| | | GW-RN0800-16 | 01 Nov 2016 | 29 Apr 2017 | | |
| | | GW-RN0822-16 | 09 Nov 2016 | 08 May 2017 | | |
| | | GW-RN0823-16 | 09 Nov 2016 | 08 May 2017 | | |
| | | GW-RN0839-16 | 20 Nov 2016 | 07 May 2017 | | |
| | | GW-RN0852-16 | 23 Nov 2016 | 2 May 2017 | | |
| | | GW-RN0895-16 | 20 Dec 2016 | 11 Jun 2017 | | |
| | | GW-RN0926-16 | 27 Dec 2016 | 26 Jun 2017 | | |
| | | GW-RN0928-16 | 27 Dec 2016 | 26 Jun 2017 | | |
| | | GW-RN0072-17 | 1 Feb 2017 | 31 Jul 2017 | | |
| | | GW-RN0073-17 | 1 Feb 2017 | 31 Jul 2017 | | |
| 6 | Specified Process License (Mortar Plant Operation) | L-3-251(1) | 12-Apr-2016 | 11-Apr-2021 | | |
| | | Contract 3 | | | | |



| T . | D 1.11 | License/Permit Status | | | | |
|------------|---|--|-----------------------|-----------------------|--|--|
| Item | Description | Ref. no. | Effective Date | Expiry Date | | |
| 1 | Air pollution Control (Construction Dust) Regulation | Ref. No: 362101 | 17 Jul 2013 | Till Contract ends | | |
| 2 | Chemical Waste Producer Registration | Waste Producers Number: No.:5113-634-C3817-01 | 7 Oct 2013 | Till Contract ends | | |
| 3 | Water Pollution Control Ordinance - Discharge License | No.:WT00016832 – 2013 | 28 Aug 13 | 31 Aug 2018 | | |
| 4 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Account No. 7017914 | 2 Aug 13 | Till Contract ends | | |
| 5 | Construction Noise | GW-RN0525-16 | 20 Jul 2016 | 7 Jan 2017 | | |
| | Permit | GW-RN0549-16 | 30 Jul 2016 | 9 Jan 2017 | | |
| | | GW-RN0561-16 | 16 Aug 2016 | 11 Feb 2017 | | |
| | | GW-RN0580-16 | 25 Aug 2016 | 24 Feb 2017 | | |
| | | GW-RN0581-16 | 25 Aug 2016 | 24 Feb 2017 | | |
| | | GW-RN0596-16 | 17 Aug 2016 | 15 Feb 2017 | | |
| | | GW-RN0619-16 | 22 Aug 2016 | 14 Feb 2017 | | |
| | | GW-RN0646-16 | 10 Sep 2016 | 9 Mar 2017 | | |
| | | GW-RN0649-16 | 3 Sep 2016 | 7 Jan 2017 | | |
| | | GW-RN0653-16 | 11 Sep 2016 | 10 Mar 2017 | | |
| | | GW-RN0654-16 | 15 Sep 2016 | 14 Mar 2017 | | |
| | | GW-RN0708-16 | 8 Oct 2016 | 28 Jan 2017 | | |
| | | GW-RN0711-16 | 1 Oct 2016 | 13 Jan 2017 | | |
| | | GW-RN0720-16 | 4 Oct 2016 | 31 Mar 2017 | | |
| | | GW-RN0729-16 | 5 Oct 2016 | 31 Mar 2017 | | |
| | | GW-RN0756-16 | 18 Oct 2016 | 13 Apr 2017 | | |
| | | GW-RN0759-16 | 5 Nov 2016 | 29 Apr 2017 | | |
| | | GW-RN0816-16 | 13 Nov2016 | 27 Mar 2017 | | |
| | | GW-RN0833-16 | 13 Nov2016 | 10 May 2017 | | |
| | | GW-RN0836-16 | 15 Nov2016 | 31 Mar 2017 | | |
| | | GW-RN0843-16 | 18 Nov2016 | 17 May 2017 | | |
| | | GW-RN0856-16 | 17 Nov2016 | 7 Jan 2017 | | |
| | | GW-RN0870-16 | 30 Nov2016 | 13 May 2017 | | |
| | | GW-RN0871-16 | 29 Nov2016 | 20 May 2017 | | |
| | | GW-RN0872-16 | 29 Nov2016 | 20 May 2017 | | |
| | | GW-RN0901-16 | 11 Dec 2016 | 4 Jun 2017 | | |
| | | GW-RN0939-16 | 22 Dec 2016 | 21 Jun 2017 | | |
| | | GW-RN0965-16 | 28 Dec 2016 | 13 Jun 2017 | | |
| | | GW-RN0002-17 | 8 Jan 2017 | 4 Jun 2017 | | |
| | | GW-RN0004-17 | 11 Jan 2017 | 18 Feb 2017 | | |
| | | GW-RN0021-17 | 19 Jan 2017 | 8 Jul 2017 | | |



| | 5 | License/Permit Status | | | | |
|------|---|--|-----------------------|-----------------------------|--|--|
| Item | Description | Ref. no. | Effective Date | Expiry Date | | |
| | | GW-RN0029-17 | 21 Jan 2017 | 8 Jul 2017 | | |
| | | GW-RN0032-17 | 25 Feb 2017 | 10 Jul 2017 | | |
| | | GW-RN0040-17 | 25 Jan 2017 | 24 Aug 2017 | | |
| | | GW-RN0048-17 | 3 Feb 2017 | 16 Jun 2017 | | |
| | | GW-RN0066-17 | 15 Feb 2017 | 15 Jul 2017 | | |
| | | GW-RN0069-17 | 15 Feb 2017 | 14 Aug 2017 | | |
| | | GW-RN0070-17 | 3 Feb 2017 | 15 Jul 2017 | | |
| | | GW-RN0071-17 | 16 Feb 2017 | 15 Aug 2017 | | |
| | | Contract 5 | | | | |
| 1 | Air pollution Control (Construction Dust) Regulation | Ref. No: 359338 | 13 May 2013 | Till the end of Contract | | |
| 2 | Chemical Waste Producer Registration | Waste Producers Number No.: 5213-642-S3735-01 | 8 Jun 2013 | Till the end of Contract | | |
| 3 | Water Pollution Control Ordinance - Discharge License | No.: W5/1G44/1 | 8 Jun 13 | 30 Jun 2018 | | |
| 4 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Account No. 7017351 | 29 Apr 13 | Till the end of Contract | | |
| | | Contract 6 | T | | | |
| 1 | Air pollution Control (Construction Dust) Regulation | Ref. No: 390614 | 29 Jun 2015 | Till the end of Contract | | |
| 2 | Chemical Waste Producer Registration | Waste Producers Number No.: 5213-652-C3969-01 | 31 Aug 2015 | Till the end of Contract | | |
| 3 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Account No. 7022707 | 9 Jul 2015 | Till the end of Contract | | |
| 4 | Water Pollution | No.:WT00024574-2016 | 31 May 2016 | 31 May 2021 | | |
| | Control Ordinance - Discharge License | No.:WT00024576-2016 | 31 May 2016 | 31 May 2021 | | |
| | | No.:WT00024742-2016 | 14 June 2016 | 30 June 2021 | | |
| | | No.:WT00024746-2016 | 14 June 2016 | 30 June 2021 | | |
| 5 | Construction Noise | GW-RN0915-16 | 20 Dec 2016 | 14 Mar 2017 | | |
| | Permit | GW-RN0937-16 | 3 Jan 2017 | 31 Mar 2017 | | |
| | | GW-RN0964-16 | 6 Jan 2017 | 5 Apr 2017 | | |
| | | GW-RW0003-17 | 16 Jan 20217 | 15 Jul 2017 | | |
| | | GW-RW0005-17 | 1 Apr 2017 | 30 Jun 2017 | | |
| | A: 11 :: C : 1 | Contract SS C505 | 12 1 1 201 5 | Till 4 1 2 | | |
| 1 | Air pollution Control (Construction Dust) | Ref. No: 390974 | 13 Jul 2015 | Till the end of Contract | | |



| T4 | Demonstrations | License/ | Effective Date | | | |
|------|---|---|-----------------------|------------------|--|--|
| Item | Description | Ref. no. | Effective Date | Expiry Date | | |
| | Regulation | | | | | |
| 2 | Chemical Waste Producer Registration | Waste Producer No.: 5213-642-L1048-07 | 16 Sep 2015 | | | |
| 3 | Water Pollution Control Ordinance - Discharge License | No.: WT00024865-2016 | 8 Jul 2016 | 30 Nov 2020 | | |
| 4 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Account No. 7022831 | 23 Jul 2015 | | | |
| 5 | Construction Noise | GW-RN0806-16 | 5 Nov 2016 | 4 May 2017 | | |
| | Permit | PP-RN0020-16 | 16 Jul 2016 | 14 Jan 2017 | | |
| | | GW-RN0520-16 | 23 Jul 2016 | 22 Jan 2017 | | |
| | | GW-RN0803-16 | 5 Nov 2016 | 4 May 2017 | | |
| | | GW-RN0065-17 | 7 Feb 2017 | 6 Aug 2017 | | |
| | | Contract 7 | | | | |
| 1 | Air pollution Control (Construction Dust) Regulation | Ref. No: 397015 | 21 Dec 2015 | | | |
| 2 | Chemical Waste Producer Registration | Waste Producer No.: 5214-641-K3202-01 | 24 Mar 2016 | | | |
| 3 | Water Pollution Control Ordinance - Discharge License | No.: WT00024422-2016 | 10 May 2016 | | | |
| 4 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Account No. 7024129 | 21 Jan 2016 | | | |
| 5 | Construction Noise Permit | GW-RN0799-16 | 5 Nov 2016 | 4 May 2017 | | |
| | | Contract 4 | | | | |
| 1 | Air pollution Control (Construction Dust) Regulation | Form of Notification of Co EPD in July 2016. | nstruction work h | nas submitted to | | |
| 2 | Chemical Waste Producer Registration | Application is under preparation | | | | |
| 3 | Water Pollution Control Ordinance - Discharge License | Application is under preparation | | | | |
| 4 | Waste Disposal Regulation - Billing Account for Disposal of Construction Waste | Application is under preparat | tion | | | |



3 SUMMARY OF IMPACT MONITORING REQUIREMENTS

3.1 GENERAL

- 3.1.1 The Environmental Monitoring and Audit requirements are set out in the Approved EM&A manual. Environmental issues such as air quality, construction noise and water quality were identified as the key issues during the construction phase of the Project.
- 3.1.2 A summary of construction phase EM&A requirements are presented in the sub-sections below.

3.2 MONITORING PARAMETERS

- 3.2.1 The EM&A program of construction phase monitoring shall cover the following environmental issues:
 - Air quality;
 - Construction noise; and
 - Water quality
- 3.2.2 A summary of the monitoring parameters is presented in *Table 3-1*.

Table 3-1 Summary of EM&A Requirements

| Environmental Issue | Parameters |
|----------------------------|---|
| Air Quality | 1-hour TSP by Real-Time Portable Dust Meter; and |
| All Quality | 24-hour TSP by High Volume Air Sampler. |
| | • L _{eq(30min)} in normal working days (Monday to Saturday) 07:00-19:00 except public holiday; and |
| Noise | • 3 sets of consecutive L _{eq(5min)} on restricted hours i.e. 19:00 to 07:00 |
| 110136 | next day, and whole day of public holiday or Sunday |
| | Supplementary information for data auditing, statistical results such |
| | as L_{10} and L_{90} shall also be obtained for reference. |
| | In-situ Measurements |
| | Dissolved Oxygen Concentration (mg/L); |
| | • Dissolved Oxygen Saturation (%); |
| | Turbidity (NTU); |
| Water Quality | • pH unit; |
| | Water depth (m); and |
| | • Temperature (°C). |
| | Laboratory Analysis |
| | Suspended Solids (mg/L) |

3.3 MONITORING LOCATIONS

3.3.1 The designated monitoring locations as recommended in the *EM&A Manual* are shown in *Appendix D*. As the access to some of the designated monitoring locations was questionable due to safety reason or denied by the landlords, alternative locations therefore have had proposed. The proposed alternative monitoring locations has updated in the revised EM&A Programme which verified by IEC and certified by ET Leader prior submitted to EPD on 10 July 2013. *Table 3-2*, *Table 3-3* and *Table 3-4* are respectively listed the air quality, construction noise and water quality monitoring locations for the Project and a map showing these monitoring stations is presented in *Appendix E*.

Table 3-2 Impact Monitoring Stations - Air Quality

| Station ID | Description | Works Area | Related to the Work Contract |
|------------|--|-----------------|---------------------------------|
| AM1b^ | Open area at Tsung Yuen Ha Village | BCP | SS C505 |
| | | | Contract 7 |
| AM2 | Village House near Lin Ma Hang Road | LMH to Frontier | Contract 6 |
| | | Closed Area | |
| AM3 | Ta Kwu Ling Fire Service Station of Ta | LMH to Frontier | Contract 6 |



| Station ID | Description | Works Area | Related to the Work Contract |
|-------------------|-----------------------------------|-----------------|---------------------------------|
| | Kwu Ling Village. | Closed Area | |
| AM4b^ | House no. 10B1 Nga Yiu Ha Village | LMH to Frontier | Contract 6 |
| | | Closed Area | |
| AM5a^ | Ping Yeung Village House | Ping Yeung to | Contract 6 |
| | | Wo Keng Shan | |
| AM6 | Wo Keng Shan Village House | Ping Yeung to | Contract 6 |
| | | Wo Keng Shan | |
| AM7b [@] | Loi Tung Village House | Sha Tau Kok | Contract 2 |
| | | Road | Contract 6 |
| AM8 | Po Kat Tsai Village No. 4 | Po Kat Tsai | Contract 2 |
| AM9b# | Nam Wa Po Village House No. 80 | Fanling | Contract 3 |

[#] Proposal for the change of air quality monitoring location from AM9a to AM9b was submitted to EPD on 4 Nov 2013 after verified by the IEC and it was approved by EPD (EPD's ref.: (15) in EP 2/N7/A/52 Pt.10 dated 8 Nov 2013).

Table 3-3 Impact Monitoring Stations - Construction Noise

| Station ID | Description | Works Area | Related to the Work Contract |
|---------------|--|--|---------------------------------|
| NM1 | Tsung Yuen Ha Village House No. 63 | ВСР | SS C505 Contract 7 |
| NM2a# | Village House near Lin Ma Hang Road | Lin Ma Hang to Frontier Closed Area | Contract 6 |
| NM3 | Ping Yeung Village House (facade facing northeast) | Ping Yeung to Wo Keng Shan | Contract 6 |
| NM4 | Wo Keng Shan Village House | Ping Yeung to Wo Keng Shan | Contract 6 |
| NM5 | Village House, Loi Tung | Sha Tau Kok Road | Contract 2, Contract 6 |
| NM6 | Tai Tong Wu Village House 2 | Sha Tau Kok Road | Contract 2, Contract 6 |
| NM7 | Po Kat Tsai Village | Po Kat Tsai | Contract 2 |
| NM8 | Village House, Tong Hang | Fanling | Contract 2 Contract 3 |
| NM9 | Village House, Kiu Tau Village | Fanling | Contract 3 |
| NM10 | Nam Wa Po Village House No. 80 | Fanling | Contract 3 |

[#] Proposal for the change of construction noise monitoring location from NM2 to NM2a was verified by the IEC on 6 May 2016 and was effective on 9 May 2016.

^{*} Proposal for the change of air quality monitoring location from AM1to AM1a was submitted to EPD on 24 March 2014 after verified by the IEC. It was approved by EPD (EPD's ref.: (6) in EP 2/N7/A/52 Pt.12 dated 9 Jun 2014).

[@] Proposal for the change of air quality monitoring location from AM7a to AM7b was submitted to EPD on 4 June 2014 after verified by the IEC. It was approved by EPD (EPD's ref.: (7) in EP 2/N7/A/52 Pt.12 dated 9 Jun 2014).

[^] Proposal for change of air quality monitoring locations was enclosed in the updated EM&A Programme which approval by EPD on 29 Mar 2016.



Table 3-4 Impact Monitoring Stations - Water Quality

| | _ | Coordi | nates of | | Related to |
|--------------------|------------------------------------|-----------------|--------------|--|--------------------------|
| Station ID | Description | | Alternative | Nature of the location the Wor | |
| | _ | Loca Easting | Northing | | Contract |
| | Downstream | Zusting | 1 (or timing | Alternative location located | SS C505 |
| WM1 | of Kong Yiu Channel | 833 679 | 845 421 | at upstream 51m of the designated location | Contract 6 |
| WM1- Control | Upstream of Kong Yiu Channel | 834 185 | 845 917 | NA | SS C505 Contract 6 |
| WM2A | Downstream of River Ganges | 834 204 | 844 471 | Alternative location located at upstream 81m of the designated location | Contract 6 |
| WM2A(a)* | Downstream of River Ganges | 834 191 | 844 474 | Alternative location located at upstream 70m of the designated location | Contract 6 |
| WM2A- Controlx# | Upstream of River Ganges | 835 377 | 844 188 | Alternative location located at upstream 160m of the designated location | Contract 6 |
| WM2B | Downstream of River Ganges | 835 433 | 843 397 | NA | Contract 6 |
| WM2B- Control | Upstream of River Ganges | 835 835 | 843 351 | Alternative location located at downstream 31m of the designated location | Contract 6 |
| WM3x# | Downstream of River Indus | 836 206 | 842 270 | Alternative location located at downstream 180m of the designated location | Contract 2 Contract 6 |
| WM3- Control | Upstream of River Indus | 836 763 | 842 400 | Alternative location located at downstream 26m of the designated location | Contract 2 Contract 6 |
| WM4 | Downstream of Ma Wat Channel | 833 850 | 838 338 | Alternative location located at upstream 11m of the designated location | Contract 2 Contract 3 |
| WM4– Control A | Kau Lung Hang Stream | 834 028 | 837 695 | Alternative location located at downstream 28m of the designated location | Contract 2 Contract 3 |
| WM4– Control B | Upstream of Ma Wat Channel | 833760 | 837395 | Alternative location located at upstream 15m of the designated location | Contract 2 Contract 3 |

Note: EPD has approved the revised EM&A Programme on 29th March 2016. If the measured water depth of the monitoring station is lower than 150 mm, alternative location (WM3x and WM2A-Controlx) based on the criteria were selected to perform water monitoring in accordance with the updated EM&A Programme (Rev. 05) (Section 4.1.4)

3.4 MONITORING FREQUENCY AND PERIOD

The requirements of impact monitoring are stipulated in *Sections 2.1.6*, *3.1.5* and *4.1.6* of the approved *EM&A Manual* and presented as follows.

Air Quality Monitoring

- 3.4.1 Frequency of impact air quality monitoring is as follows:
 - 1-hour TSP 3 times every six days during course of works

^{*} Proposal for the change of water monitoring location from WM2A to WM2A(a) was verified by the IEC and it was approved by EPD. (EPD's ref. (10) in EP 2/N7/A/52 Pt.19)



24-hour TSP Once every 6 days during course of works.

Noise Monitoring

3.4.2 One set of $L_{eq(30min)}$ as 6 consecutive $L_{eq(5min)}$ between 0700-1900 hours on normal weekdays and once every week during course of works. If construction work necessary to carry out at other time periods, i.e. restricted time period (19:00 to 07:00 the next morning and whole day on public holidays) (hereinafter referred as "the restricted hours"), additional weekly impact monitoring for $L_{eq(5min)}$ measurement shall be employed during respective restricted hours periods.. Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.

Water Quality Monitoring

3.4.3 The water quality monitoring frequency shall be 3 days per week during course of works. The interval between two sets of monitoring shall not be less than 36 hours.

3.5 MONITORING EQUIPMENT

Air Quality Monitoring

- 3.5.1 The 24-hour and 1-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the *Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B.* If the ET proposes to use a direct reading dust meter to measure 1-hour TSP levels, it shall submit sufficient information to the IEC to approve.
- 3.5.2 The filter paper of 24-hour TSP measurement shall be determined by HOKLAS accredited laboratory.
- 3.5.3 All equipment to be used for air quality monitoring is listed in *Table 3-5*.

Table 3-5 Air Quality Monitoring Equipment

| Equipment | Model | | | |
|-------------------------|--|--|--|--|
| 24-Hr TSP | | | | |
| High Volume Air Sampler | TISCH High Volume Air Sampler, HVS Model TE-5170* | | | |
| Calibration Kit | TISCH Model TE-5025A* | | | |
| | 1-Hour TSP | | | |
| Portable Dust Meter | Sibata LD-3B Laser Dust monitor Particle Mass Profiler & | | | |
| Fortable Dust Meter | Counter* | | | |

^{*} Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

Wind Data Monitoring Equipment

- 3.5.4 According to the approved EM&A Manual, wind data monitoring equipment shall also be provided and set up for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
 - 1) The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
 - 2) The wind data should be captured by a data logger. The data shall be downloaded for analysis at least once a month.
 - 3) The wind data monitoring equipment should be re-calibrated at least once every six months
 - 4) Wind direction should be divided into 16 sectors of 22.5 degrees each.
- 3.5.5 ET has liaised with the landlords of the successful granted HVS installation premises. However, the owners rejected to provide premises for wind data monitoring equipment installation.



3.5.6 Under this situation, the ET proposed alternative methods to obtain representative wind data. Meteorological information as extracted from "the Hong Kong Observatory Ta Kwu Ling Station" is alternative method to obtain representative wind data. For Ta Kwu Ling Station, it is located nearby the Project site. Moreover, this station is located at 15m above mean sea level while its anemometer is located at 13m above the existing ground which in compliance with the general setting up requirement. Furthermore, this station also can be to provide the humidity, rainfall, and air pressure and temperature etc. meteorological information. In Hong Kong of a lot development projects, weather information extracted from Hong Kong Observatory is common alternative method if weather station installation not allowed.

Noise Monitoring

- 3.5.7 Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. The sound level meter shall be checked using an acoustic calibrator. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.
- 3.5.8 Noise monitoring equipment to be used for monitoring is listed in *Table 3-6*.

Table 3-6 Construction Noise Monitoring Equipment

| Equipment | Model |
|-------------------------------|---|
| Integrating Sound Level Meter | B&K Type 2238* or Rion NL-31 or Rion NL-52* |
| Calibrator | B&K Type 4231* or Cesva CB-5 or Rion NC-74* |
| Portable Wind Speed Indicator | Testo Anemometer |

^{*} Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

3.5.9 Sound level meters listed above comply with the *International Electrotechnical Commission Publications 651: 1979 (Type 1)* and *804: 1985 (Type 1)* specifications, as recommended in TM issued under the NCO. The acoustic calibrator and sound level meter to be used in the impact monitoring will be calibrated yearly.

Water Quality Monitoring

- 3.5.10 DO and water temperature should be measured in-situ by a DO/temperature meter. The instrument should be portable and weatherproof using a DC power source. It should have a membrane electrode with automatic temperature compensation complete with a cable. The equipment should be capable of measuring:
 - a DO level in the range of 0-20 mg/l and 0-200% saturation; and
 - a temperature of between 0 and 45 degree Celsius.
- 3.5.11 A portable pH meter capable of measuring a range between 0.0 and 14.0 should be provided to measure pH under the specified conditions accordingly to the APHA Standard Methods.
- 3.5.12 The instrument should be portable and weatherproof using a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0-1000 NTU.
- 3.5.13 A portable, battery-operated echo sounder or tape measure will be used for the determination of water depth at each designated monitoring station as appropriate.
- 3.5.14 A water sampler e.g. Kahlsico Water Sampler, which is a transparent PVC cylinder with capacity not less than 2 litres, will be used for water sampling if water depth over than 0.5m. For sampling from very shallow water depths e.g. <0.5 m, water sample collection will be directly from water surface below 100mm use sampling plastic bottle to avoid inclusion of bottom sediment or humus. Moreover, Teflon/stainless steel bailer or self-made sampling buckets maybe used for water sampling. The equipment used for sampling will be depended the sampling location and depth situations.



- 3.5.15 Water samples for laboratory measurement of SS will be collected in high density polythene bottles, packed in ice (cooled to 4 °C without being frozen), and delivered to the laboratory in the same day as the samples were collected.
- 3.5.16 Analysis of suspended solids should be carried out in a HOKLAS or other accredited laboratory. Water samples of about 1L should be collected at the monitoring stations for carrying out the laboratory suspended solids determination. The SS determination work should start within 24 hours after collection of the water samples. The SS analyses should follow the *APHA Standard Methods 2540D* with Limit of Reporting of 2 mg/L.
- 3.5.17 Water quality monitoring equipment used in the impact monitoring is listed in *Table 3-7*. Suspended solids (SS) analysis is carried out by a local HOKLAS-accredited laboratory, namely *ALS Technichem (HK) Pty Ltd*.

Table 3-7 Water Quality Monitoring Equipment

| Equipment | Model |
|------------------------|---|
| Water Depth Detector | Eagle Sonar or tape measures |
| Water Sampler | A 2-litre transparent PVC cylinder with latex cups at both ends or teflon/stainless steel bailer or self-made sampling bucket |
| Thermometer & DO meter | YSI Professional Plus /YSI PRO20 Handheld Dissolved Oxygen Instrument*/ YSI 550A Multifunctional Meter/ YSI Professional DSS |
| pH meter | YSI Professional Plus / AZ8685 pH pen-style meter*/ YSI 6820/650MDS/ YSI Professional DSS |
| Turbidimeter | Hach 2100Q*/ YSI 6820/ 650MDS/ YSI Professional DSS |
| Sample Container | High density polythene bottles (provided by laboratory) |
| Storage Container | 'Willow' 33-liter plastic cool box with Ice pad |

^{*} Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

3.6 MONITORING METHODOLOGY

1-hour TSP Monitoring

- 3.6.1 The 1-hour TSP monitor was a brand named "Sibata LD-3B Laser Dust monitor Particle Mass Profiler & Counter" which is a portable, battery-operated laser photometer. The 1-hour TSP meter provides a real time 1-hour TSP measurement based on 90° light scattering. The 1-hour TSP monitor consists of the following:
 - (a.) A pump to draw sample aerosol through the optic chamber where TSP is measured;
 - (b.) A sheath air system to isolate the aerosol in the chamber to keep the optics clean for maximum reliability; and
 - (c.) A built-in data logger compatible with Windows based program to facilitate data collection, analysis and reporting.
- 3.6.2 The 1-hour TSP meter is used within the valid period as follow manufacturer's Operation and Service Manual.

24-hour TSP Monitoring

- 3.6.3 The equipment used for 24-hour TSP measurement is Tisch Environmental, Inc. Model TE-5170 TSP high volume air sampling system, which complied with *EPA Code of Federal Regulation, Appendix B to Part 50*. The High Volume Air Sampler (HVS) consists of the following:
 - (a.) An anodized aluminum shelter;
 - (b.) A 8"x10" stainless steel filter holder;
 - (c.) A blower motor assembly;
 - (d.) A continuous flow/pressure recorder;



- (e.) A motor speed-voltage control/elapsed time indicator;
- (f.) A 7-day mechanical timer, and
- (g.) A power supply of 220v/50 Hz
- 3.6.4 The HVS is operated and calibrated on a regular basis in accordance with the manufacturer's instruction using Tisch Calibration Kit Model TE-5025A. Calibration would carry out in two month interval.
- 3.6.5 24-hour TSP is collected by the ET on filters of HVS and quantified by a local HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (ALS), upon receipt of the samples. The ET keep all the sampled 24-hour TSP filters in normal air conditioned room conditions, i.e. 70% RH (Relative Humidity) and 25°C, for six months prior to disposal.

Noise Monitoring

- Noise measurements were taken in terms of the A-weighted equivalent sound pressure level (L_{eq}) measured in decibels dB(A). Supplementary statistical results (L_{10} and L_{90}) were also obtained for reference.
- 3.6.7 During the monitoring, all noise measurements would be performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}). Leq_(30min) in six consecutive Leq_(5min) measurements will use as the monitoring parameter for the time period between 0700-1900 hours on weekdays; Leq_(5min) measurements would be used as monitoring parameter for other time periods (e.g. during restricted hours), if necessary.
- 3.6.8 Prior of noise measurement, the accuracy of the sound level meter is checked using an acoustic calibrator generating a known sound pressure level at a known frequency. The checking is performed before and after the noise measurement.

Water Quality

3.6.9 Water quality monitoring is conducted at the designated or alternative locations. The sampling procedures with the in-situ monitoring are presented as below:

Sampling Procedure

- 3.6.10 A Digital Global Positioning System (GPS) is used to identify the designated monitoring stations prior to water sampling. A portable, battery-operated echo sounder or tape measurement is used for the determination of water depth at each station. At each station, water sample would be collected from 0.1m below water surface or the water surface to prevent the river bed sediment for stirring.
- 3.6.11 The sample container will be rinsed with a portion of the water sample. The water sample then will be transferred to the high-density polythene bottles as provided by the laboratory, labeled with a unique sample number and sealed with a screw cap.
- 3.6.12 Before sampling, general information such as the date and time of sampling, weather condition as well as the personnel responsible for the monitoring would be recorded on the field data sheet.
- 3.6.13 A 'Willow' 33-liter plastic cool box packed with ice will be used to preserve the water samples prior to arrival at the laboratory for chemical determination. The water temperature of the cool box is maintained at a temperature as close to 4^oC as possible without being frozen. Samples collected are delivered to the laboratory upon collection.

In-situ Measurement

3.6.14 YSI PRO20 Handheld Dissolved Oxygen Instrument is used for water in-situ measures, which automates the measurements and data logging of temperature, dissolved oxygen and dissolved oxygen saturation.



- 3.6.15 A portable AZ Model 8685 is used for in-situ pH measurement. The pH meter is capable of measuring pH in the range of 0 14 and readable to 0.1.
- 3.6.16 A portable Hach 2100Q Turbidimeter is used for in-situ turbidity measurement. The turbidity meter is capable of measuring turbidity in the range of 0 1000 NTU.
- 3.6.17 All in-situ measurement equipment are calibrated by HOKLAS accredited laboratory of three month interval.

Laboratory Analysis

3.6.18 All water samples analyzed Suspended Solids (SS) will be carried out by a local HOKLAS-accredited testing laboratory (ALS Technichem (HK) Pty Ltd HOKLAS registration no. 66). SS determination using *APHA Standard Methods 2540D* as specified in the *EM&A Manual* will start within 48 hours of water sample receipt.

3.7 EQUIPMENT CALIBRATION

- 3.7.1 Calibration of the HVS is performed upon installation and thereafter at bimonthly intervals in accordance with the manufacturer's instruction using the certified standard calibrator (TISCH Model TE-5025A). Moreover, the Calibration Kit would be calibrated annually. The calibration data are properly documented and the records are maintained by ET for future reference.
- 3.7.2 The 1-hour TSP meter was calibrated by the supplier prior to purchase. Zero response of the equipment would be checked before and after each monitoring event. Annually calibration with the High Volume Sampler (HVS) in same condition would be undertaken by the Laboratory.
- 3.7.3 The sound level meter and calibrator are calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme at yearly basis.
- 3.7.4 All water quality monitoring equipment would be calibrated by HOKLAS accredited laboratory of three month intervals.
- 3.7.5 The calibration certificates of all monitoring equipment used for the impact monitoring program in the Reporting Period and the HOKLAS accredited certificate of laboratory are attached in *Appendix F*.

3.8 DERIVATION OF ACTION/LIMIT (A/L) LEVELS

3.8.1 The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. According to the approved Environmental Monitoring and Audit Manual, the air quality, construction noise and water quality criteria were set up, namely Action and Limit levels are listed in *Tables 3-8*, *3-9* and *3-10*.

Table 3-8 Action and Limit Levels for Air Quality Monitoring

| Manitaring Station | Action 1 | Level (μg/m³) | Limit I | Level (µg/m³) |
|--------------------|------------|---------------|------------|---------------|
| Monitoring Station | 1-hour TSP | 24-hour TSP | 1-hour TSP | 24-hour TSP |
| AM1b | 265 | 143 | | |
| AM2 | 268 | 149 | | |
| AM3 | 269 | 145 | | |
| AM4b | 267 | 148 | | |
| AM5a | 268 | 143 | 500 | 260 |
| AM6 | 269 | 148 | | |
| AM7b | 275 | 156 | | |
| AM8 | 269 | 144 | | |
| AM9b | 271 | 151 | | |



Table 3-9 Action and Limit Levels for Construction Noise

| Monitoring Location | Action Level | Limit Level in dB(A) | |
|---|---|---|--|
| Withintoning Location | Time Period: 0700-1900 hours on normal weekdays | | |
| NM1, NM2a, NM3, NM4, NM5, NM6, NM7, NM8, NM9, NM10 | When one or more documented complaints are received | 75 dB(A) ^{Note 1 & Note 2} | |

Note 1: Acceptable Noise Levels for school should be reduced to 70 dB(A) and65 dB(A) during examination period

Table 3-10 Action and Limit Levels for Water Quality

| Parameter | Performance | Monitoring Location | | | | |
|-----------|--------------|----------------------------------|--|---------------------|-----------------------|---------------------|
| Parameter | criteria | WM1 | WM2A(a) | WM2B | WM3x | WM4 |
| DO | Action Level | (*)4.23 | (**)4.00 | ^(*) 4.74 | (**)4.00 | (*)4.14 |
| (mg/L) | Limit Level | ^(#) 4.19 | (**)4.00 | ^(#) 4.60 | (**)4.00 | ^(#) 4.08 |
| | Action Level | 51.3 | 24.9 11.4 13.4 35. | | | |
| Turbidity | Action Level | AND 120% of upstream control sta | | tation of the s | ation of the same day | |
| (NTU) | Limit Level | 67.6 | 33.8 | 12.3 | 14.0 | 38.4 |
| | | AND | 130% of upstream control station of the same day | | | |
| | Action Level | 54.5 | 14.6 | 11.8 | 12.6 | 39.4 |
| SS (mg/I) | Action Level | AND | AND 120% of upstream control station o | | tation of the s | ame day |
| SS (mg/L) | т: :, т 1 | 64.9 | 17.3 | 12.4 | 12.9 | 45.5 |
| | Limit Level | AND | 130% of upstream control station of the same day | | | |

Remarks:

3.8.2 Should non-compliance of the environmental quality criteria occurs, remedial actions will be triggered according to the Event and Action Plan which presented in *Appendix G*.

3.9 DATA MANAGEMENT AND DATA QA/QC CONTROL

- 3.9.1 All monitoring data will be handled by the ET's in-house data recording and management system. The monitoring data recorded in the equipment will be downloaded directly from the equipment at the end of each monitoring day. The downloaded monitoring data will input into a computerized database maintained by the ET. The laboratory results will be input directly into the computerized database and checked by personnel other than those who input the data.
- For monitoring parameters that require laboratory analysis, the local laboratory shall follow the QA/QC requirements as set out under the HOKLAS scheme for the relevant laboratory tests.

Note 2: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.

^(*) The Proposed <u>Action Level</u> of Dissolved Oxygen is adopted to be used 5%-ile of baseline data (**) The Proposed <u>Action & Limit Level</u> of Dissolved Oxygen is used 4mg/L

^(#) The Proposed Limit Level of Dissolved Oxygen is adopted to be used 1%-ile of baseline data



4 AIR QUALITY MONITORING

4.1 GENERAL

- 4.1.1 In the Reporting Period, construction works under the project have been commenced in Contracts 2, 3, 6, 7 and Contract SS C505. Hence, air quality monitoring was performed at all designated locations.
- 4.1.2 The air quality monitoring schedule is presented in *Appendix H* and the monitoring results are summarized in the following sub-sections.

4.2 AIR QUALITY MONITORING RESULTS

4.2.1 In the Reporting Period, a total of 135 events of 1-hour TSP and 45 events 24-hours TSP monitoring were carried out and the monitoring results are summarized in Tables 4-1 to 4-9. The detailed 24-hour TSP monitoring data are presented in Appendix I and the relevant graphical plots are shown in Appendix J.

Table 4-1 Summary of 24-hour and 1-hour TSP Monitoring Results – AM1b

| | 24-hour | 1-hour TSP (μg/m³) | | | | |
|-----------|-------------------|--------------------|---------------|-------------------------|-------------------------|-------------------------|
| Date | $TSP (\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading |
| 3-Jan-17 | 94 | 4-Jan-17 | 9:28 | 78 | 59 | 56 |
| 9-Jan-17 | 114 | 10-Jan-17 | 9:13 | 91 | 93 | 105 |
| 14-Jan-17 | 56 | 16-Jan-17 | 9:51 | 103 | 126 | 124 |
| 20-Jan-17 | 124 | 21-Jan-17 | 13:12 | 107 | 105 | 102 |
| 26-Jan-17 | 71 | 26-Jan-17 | 9:19 | 104 | 92 | 86 |
| Average | 92 | Average | | 95 | | |
| (Range) | (56 - 124) | (Rang | ge) | | (56 - 126) | |

Table 4-2 Summary of 24-hour and 1-hour TSP Monitoring Results – AM2

| | 24-hour | 1-hour TSP (μg/m³) | | | | |
|-----------|--------------------------|--------------------|---------------|-------------------------|-------------------------|-------------------------|
| Date | TSP (µg/m ³) | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading |
| 3-Jan-17 | 147 | 4-Jan-17 | 9:18 | 122 | 101 | 117 |
| 9-Jan-17 | 33 | 10-Jan-17 | 9:21 | 115 | 113 | 107 |
| 14-Jan-17 | 63 | 16-Jan-17 | 19:45 | 106 | 131 | 146 |
| 20-Jan-17 | 129 | 21-Jan-17 | 13:17 | 100 | 97 | 101 |
| 26-Jan-17 | 116 | 26-Jan-17 | 9:15 | 145 | 131 | 118 |
| Average | 98 | Average | | 117 | | |
| (Range) | (33 - 147) | (Range) | | (97 – 146) | | |

Table 4-3 Summary of 24-hour and 1-hour TSP Monitoring Results – AM3

| | 24-hour | | 1 | -hour TSP (µg | g/m ³) | | | | |
|-----------------|-------------------|----------------|---------------|-------------------------|-------------------------|-------------------------|--|--|--|
| Date | TSP $(\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading | | | |
| 3-Jan-17 | 97 | 4-Jan-17 | 9:12 | 99 | 88 | 73 | | | |
| 9-Jan-17 | 118 | 10-Jan-17 | 9:37 | 151 | 113 | 125 | | | |
| 14-Jan-17 | 101 | 16-Jan-17 | 9:41 | 108 | 178 | 206 | | | |
| 20-Jan-17 | 123 | 21-Jan-17 | 13:31 | 98 | 104 | 95 | | | |
| 26-Jan-17 | 126 | 26-Jan-17 | 9:10 | 128 | 116 | 105 | | | |
| Average (Range) | 113 (97 - 123) | Avera (Rang | • | | 119 (73 – 206) | | | | |



Table 4-4 Summary of 24-hour and 1-hour TSP Monitoring Results – AM4b

| | 24 1 | 1-hour TSP (µg/m³) | | | | | |
|-----------------|---------------------------|--------------------|---------------|-------------------------|-------------------------|-------------------------|--|
| Date | 24-hour TSP (µg/m³) | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading | |
| 4-Jan-17 | 78 | 5-Jan-17 | 9:16 | 76 | 100 | 86 | |
| 10-Jan-17 | 76 | 11-Jan-17 | 9:30 | 66 | 60 | 59 | |
| 16-Jan-17 | 44 | 17-Jan-17 | 9:51 | 108 | 104 | 110 | |
| 21-Jan-17 | 67 | 23-Jan-17 | 9:50 | 114 | 106 | 94 | |
| 27-Jan-17 | 55 | 27-Jan-17 | 9:40 | 111 | 108 | 111 | |
| Average (Range) | 64 (44 – 78) | Avera (Rang | ~ | | 94 (59 – 114) | | |

Table 4-5 Summary of 24-hour and 1-hour TSP Monitoring Results – AM5a

| | 24-hour | | 1 | -hour TSP (μg | g/m ³) | |
|-----------------|-------------------|----------------|---------------|-------------------------|-------------------------|-------------------------|
| Date | TSP $(\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading |
| 4-Jan-17 | 73 | 5-Jan-17 | 9:23 | 89 | 86 | 95 |
| 10-Jan-17 | 92 | 11-Jan-17 | 9:36 | 60 | 65 | 65 |
| 16-Jan-17 | 62 | 17-Jan-17 | 13:17 | 108 | 124 | 126 |
| 21-Jan-17 | 97 | 23-Jan-17 | 9:45 | 101 | 90 | 70 |
| 27-Jan-17 | 113 | 27-Jan-17 | 9:32 | 107 | 103 | 105 |
| Average (Range) | 87 (62 – 113) | Avera (Rang | - | | 93 (60 – 126) | |

Table 4-6 Summary of 24-hour and 1-hour TSP Monitoring Results – AM6

| | 24-hour | | 1 | -hour TSP (μg | g/m^3) | |
|-----------|-------------------|-----------|---------------|-------------------------|-------------------------|-------------------------|
| Date | TSP $(\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading |
| 4-Jan-17 | 72 | 5-Jan-17 | 9:31 | 95 | 109 | 110 |
| 10-Jan-17 | 88 | 11-Jan-17 | 9:24 | 62 | 62 | 61 |
| 16-Jan-17 | 78 | 17-Jan-17 | 9:55 | 113 | 118 | 130 |
| 21-Jan-17 | 146 | 23-Jan-17 | 9:35 | 114 | 104 | 83 |
| 27-Jan-17 | 67 | 27-Jan-17 | 9:25 | 108 | 110 | 111 |
| Average | 90 | Average | | 99 | | |
| (Range) | (67 - 146) | (Rang | ge) | | (61 - 130) | |

Table 4-7 Summary of 24-hour and 1-hour TSP Monitoring Results – AM7b

| | 24-hour | | 1 | -hour TSP (µg | g/m ³) | |
|-----------|-------------------|-----------|---------------|-------------------------|-------------------------|-------------------------|
| Date | TSP $(\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading |
| 4-Jan-17 | 98 | 5-Jan-17 | 9:53 | 98 | 106 | 110 |
| 10-Jan-17 | 130 | 11-Jan-17 | 9:24 | 70 | 58 | 61 |
| 16-Jan-17 | 50 | 17-Jan-17 | 9:29 | 111 | 118 | 123 |
| 21-Jan-17 | 139 | 23-Jan-17 | 9:30 | 110 | 99 | 78 |
| 27-Jan-17 | 99 | 27-Jan-17 | 9:15 | 120 | 121 | 124 |
| Average | 103 | Average | | 100 | | |
| (Range) | (50 - 139) | (Rang | ge) | | (58 - 124) | |



Table 4-8 Summary of 24-hour and 1-hour TSP Monitoring Results – AM8

| | 24-hour | | 1 | -hour TSP (μg | g/m ³) | | | | |
|-----------------|-------------------|----------------|---------------|-------------------------|-------------------------|-------------------------|--|--|--|
| Date | TSP $(\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading | | | |
| 4-Jan-17 | 59 | 5-Jan-17 | 12:50 | 91 | 105 | 110 | | | |
| 10-Jan-17 | 67 | 11-Jan-17 | 12:50 | 65 | 75 | 64 | | | |
| 16-Jan-17 | 22 | 17-Jan-17 | 9:36 | 116 | 125 | 127 | | | |
| 21-Jan-17 | 73 | 23-Jan-17 | 9:20 | 129 | 119 | 98 | | | |
| 27-Jan-17 | 57 | 27-Jan-17 | 9:00 | 115 | 117 | 119 | | | |
| Average (Range) | 56 (22 – 73) | Avera (Rang | ~ | | 105 (64 -129) | | | | |

Table 4-9 Summary of 24-hour and 1-hour TSP Monitoring Results – AM9b

| | 24-hour | | 1 | -hour TSP (µg | g/m ³) | | | | |
|-----------|-------------------|-----------|---------------|-------------------------|-------------------------|-------------------------|--|--|--|
| Date | TSP $(\mu g/m^3)$ | Date | Start Time | 1 st reading | 2 nd reading | 3 rd reading | | | |
| 3-Jan-17 | 61 | 4-Jan-17 | 13:12 | 119 | 96 | 84 | | | |
| 9-Jan-17 | 52 | 10-Jan-17 | 13:13 | 177 | 174 | 159 | | | |
| 14-Jan-17 | 36 | 16-Jan-17 | 13:21 | 127 | 109 | 118 | | | |
| 20-Jan-17 | 61 | 26-Jan-17 | 8:45 | 36 | 31 | 52 | | | |
| 26-Jan-17 | 48 | 27-Jan-17 | 13:16 | 130 | 107 | 95 | | | |
| Average | 52 | Avera | Average 108 | | 108 | | | | |
| (Range) | (36 - 61) | (Rang | ge) | | (31–177) | | | | |

- 4.2.1 As shown in *Tables 4-1 to 4-9*, all the 1-hour TSP and 24-hour TSP monitoring results were below the Action/Limit Levels. No Notification of Exceedance (NOE) was issued in this Reporting Period.
- 4.2.2 The meteorological data during the impact monitoring days are summarized in *Appendix K*.



5 CONSTRUCTION NOISE MONITORING

5.1 GENERAL

- In the Reporting Period, construction works under the project have been commenced in Contracts 2, 3, 6, 7 and Contract SS C505 and noise monitoring was performed at all designated locations.
- 5.1.2 The noise monitoring schedule is presented in *Appendix H* and the monitoring results are summarized in the following sub-sections.

5.2 NOISE MONITORING RESULTS (NORMAL DAYTIME)

5.2.1 In the Reporting Period, a total of **40** event noise measurements were carried out at the designated locations. The sound level meter was set in 1m from the exterior of the building façade including noise monitoring locations NM1, NM3, NM4, NM5, NM6, NM7, NM8 and NM9. Therefore, no façade correction (+3 dB(A)) is added according to acoustical principles and EPD guidelines. However, free-field status were performed at NM2a and NM10 and façade correction (+3 dB(A)) has added according to the requirement in this month. The noise monitoring results at the designated locations are summarized in *Tables 5-1 and 5-2*. The detailed noise monitoring data are presented in *Appendix I* and the relevant graphical plots are shown in *Appendix J*.

Table 5-1 Summary of Construction Noise Monitoring Results

| | Construction Noise Level (L _{eq30min}), dB(A) | | | | | |
|----------------------|---|---------------------|-----|-----|---------------------|--|
| Date | NM1 | NM2a ^(*) | NM8 | NM9 | NM10 ^(*) | |
| 4-Jan-17 | 54 | 69 | 59 | 63 | 66 | |
| 10-Jan-17 | 54 | 71 | 57 | 63 | 68 | |
| 16-Jan-17 | 55 | 65 | 59 | 64 | 67 | |
| 26-Jan-17 | 63 | 69 | 58 | 62 | 65 | |
| Limit Level 75 dB(A) | | | | | | |

Remarks

Table 5-2 Summary of Construction Noise Monitoring Results

| | Construction Noise Level (L _{eq30min}), dB(A) | | | | | | |
|-------------|---|-----|-----|-----|-----|--|--|
| Date | NM3 | NM4 | NM5 | NM6 | NM7 | | |
| 5-Jan-17 | 60 | 65 | 54 | 59 | 63 | | |
| 11-Jan-17 | 61 | 68 | 61 | 62 | 60 | | |
| 17-Jan-17 | 62 | 63 | 57 | 57 | 59 | | |
| 23-Jan-17 | 63 | 65 | 53 | 57 | 60 | | |
| Limit Level | evel 75 dB(A) | | | | | | |

5.2.2 As shown in *Tables 5-1 and 5-2*, the noise level measured at all designated monitoring locations were below 75dB(A). Moreover, no valid noise complaint (which triggered Action Level exceedance) was recorded in the Reporting Period.

5.3 Noise Monitoring Results (Restricted Hours)

- 5.3.1 In the Reporting Period, CNPs were granted by Contracts 2, 3, 6, 7 and SS C505 for use of Powered Mechanical Equipment (PME) during restricted hour. As confirmed by both Contractors with their works schedules, construction works would be conducted at Contract 2, 3, 6 and SS C505 during restricted hours with the granted CNP. Noise monitoring was therefore conducted at the relevant noise monitoring locations during respective restricted hour periods.
- 5.3.2 Based on the works schedule by the Contractor of Contracts 2, 3, 6, 7 and SS C505, the involved noise monitoring locations included NM4, NM5, NM7, NM8, NM9 and NM10 and the noise monitoring results are summarized in *Tables 5-3 and 5-4*.

 $^{^{(*)}}$ façade correction (+3 dB(A) is added according to acoustical principles and EPD guidelines



Table 5-3 Summary of Construction Noise Monitoring Results (Evening Time)

| | Construction Noise Level (L _{eq5min}), dB(A) | | | | | | | |
|-------------|--|---|--|-----------------|--|--|--|--|
| Date | NM4 | NM5 | NM7 | NM8 | | | | |
| | $L_{ m eq5min}$ | $L_{ m eq5min}$ | $ m L_{eq5min}$ | $L_{ m eq5min}$ | | | | |
| 6-Jan-17 | 42.3 | 47.4 | 45.3 | 57.1 | | | | |
| 13-Jan-17 | 53.1 | 47.3 | 48.7 | 64.3 | | | | |
| 20-Jan-17 | 55.8 | 44.5 | 51.3 | 59.1 | | | | |
| 26-Jan-17 | 45.9 | 46.6 | 48.6 | 60.1 | | | | |
| other noise | dogs barking from | Noise from vehicle parking, occasionally dogs barking from village | Noise from water flowing in the gully occasionally dogs barking from village | | | | | |

Remarks: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.

Table 5-4 Summary of Construction Noise Monitoring Results (Night Time)

| Construction Noise Level (L _{eq5min}), dB(A) | | | | | | | |
|--|-----------------|---|-----------------|------------------------------|---------------------|--|--|
| Date (#) | NM5 | NM7 | NM8 | NM9 | NM10 ^(*) | | |
| | $L_{ m eq5min}$ | $ m L_{eq5min}$ | $ m L_{eq5min}$ | $ m L_{eq5min}$ | $ m L_{eq5min}$ | | |
| 6-Jan-17 | 53.0 | 45.0 | 56.4 | | | | |
| 13-Jan-17 | 45.6 | 49.4 | 58.8 | | | | |
| 20-Jan-17 | 46.2 | 45.5 | 55.6 | 65.6 | 61 | | |
| 26-Jan-17 | 45.0 | 55.2 | 57.9 | 60.2 | 62.1 | | |
| Observation/ other noise source | dogs barking | Noise from water flowing in the gully, occasionally dogs barking from village | from trains as | occasionally dogs barking | and occasionally | | |

Remarks: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.

- (#) the monitoring date for NM9 and NM10 shall be the next day of the "Date"
- (*) façade correction (+3 dB(A) is added according to acoustical principles and EPD guidelines

5.3.3 According to the site records by the monitoring team, no construction noise from the construction was noted during the course of monitoring at all locations. On the other hand, traffic noise was dominated at NM8 and NM9 since the monitoring locations were closed to the train tracks and occasionally noise from vehicle and dogs barking were recorded at all stations. Therefore, it is considered that the measurement results were likely to be the background noise.



6 WATER QUALITY MONITORING

6.1 GENERAL

6.1.1 In the Reporting Period, construction works under the project has been commenced in Contracts 2, 3, 6, 7 and Contract SS C505 and water quality monitoring was performed at all designated locations. The water quality monitoring schedule is presented in *Appendix H*. The monitoring results are summarized in the following sub-sections.

6.2 RESULTS OF WATER QUALITY MONITORING

- 6.2.1 In the Reporting Period, a total of twelve (12) sampling days was scheduled to carry out for all designated locations with their control stations. Since exceedances were recorded at WM4, according to "Event and Action Plan" stipulation, one (1) additional water quality monitoring day was conducted for WM4 and its control stations in the reporting period.
- 6.2.2 The key monitoring parameters including Dissolved Oxygen, Turbidity and Suspended Solids are summarized in *Tables 6-1 to 6-5*. Breaches of water quality monitoring criteria are shown in *Table 6-6*. Detailed monitoring database including in-situ measurements and laboratory analysis data are shown in *Appendix I* and the relevant graphical plot are shown in *Appendix J*.

Table 6-1 Water Quality Monitoring Results Associated of Contracts 2 and 3

| Date | Dissolved Oxygen (mg/L) | | Turbidity (NTU) | | | Suspended Solids (mg/L) | | | |
|------------|----------------------------|--------|--------------------|------|-----------|----------------------------|-------|--------|--------|
| | WM4 | WM4-CA | WM4-CB | WM4 | WM4-CA | WM4-CB | WM4 | WM4-CA | WM4-CB |
| 3-Jan-17 | 8.1 | 7.8 | 5.9 | 12.8 | 4.4 | 9.4 | 16.0 | 3.5 | 9.5 |
| 5-Jan-17 | 8.0 | 8.2 | 6.4 | 14.2 | 15.7 | 12.9 | 12.0 | 15.0 | 9.0 |
| 7-Jan-17 | 8.1 | 8.4 | 6.1 | 21.0 | 13.8 | 12.9 | 16.0 | 9.0 | 10.0 |
| 10-Jan-17 | 7.8 | 8.0 | 6.2 | 13.9 | overrange | 29.8 | 13.0 | 690.5 | 36.5 |
| 12-Jan-17 | 7.0 | 7.7 | 4.4 | 17.7 | 215.0 | 25.1 | 17.0 | 158.5 | 14.5 |
| 14-Jan-17 | 7.8 | 8.5 | 6.4 | 28.8 | 39.6 | 10.9 | 25.0 | 88.0 | 7.5 |
| 17-Jan-17 | 7.8 | 8.7 | 6.1 | 15.9 | 35.7 | 8.1 | 15.0 | 19.0 | 6.0 |
| 19-Jan-17 | 7.3 | 8.4 | 6.0 | 20.6 | 6.5 | 9.1 | 22.0 | 2.5 | 7.0 |
| 21-Jan-17 | 7.9 | 9.2 | 6.7 | 73.3 | 6.8 | 12.8 | 126.5 | <2 | 10.0 |
| 23-Jan-17# | 8.5 | 9.5 | 7.2 | 13.1 | 4.4 | 7.2 | 14.0 | <2 | 6.5 |
| 24-Jan-17# | | | | 9.1 | 2.6 | 5.2 | 17.0 | <2 | 7.0 |
| 25-Jan-17 | 8.2 | 10.2 | 6.2 | 22.8 | 5.2 | 9.8 | 20.5 | 2.0 | 8.0 |
| 27-Jan-17 | 8.1 | 10.0 | 6.1 | 6.4 | 4.4 | 7.7 | 5.5 | 3.0 | 7.5 |

Remarks: bold with underline indicated Limit Level exceedance

Table 6-2 Water Quality Monitoring Results Associated of Contracts 5, 6 and SS C505

| Date | Dissolved Oxygen (mg/L) | | Turbidity (NTU) | | Suspended Solids (mg/L) | |
|-----------|----------------------------|-------|--------------------|-------|----------------------------|-------|
| | WM1 | WM1-C | WM1 | WM1-C | WM1 | WM1-C |
| 3-Jan-17 | 8.1 | 8.0 | 26.7 | 3.8 | 22.0 | 4.0 |
| 5-Jan-17 | 7.6 | 7.5 | 18.1 | 5.5 | 17.0 | 2.0 |
| 7-Jan-17 | 7.5 | 7.7 | 18.9 | 4.2 | 18.5 | <2 |
| 10-Jan-17 | 7.5 | 7.4 | 36.4 | 4.6 | 38.5 | 2.5 |
| 12-Jan-17 | 8.0 | 6.8 | 39.5 | 4.7 | 38.0 | <2 |
| 14-Jan-17 | 9.2 | 9.7 | 50.5 | 5.0 | 40.5 | 2.0 |
| 17-Jan-17 | 8.8 | 8.6 | 28.3 | 3.8 | 25.0 | 2.0 |
| 19-Jan-17 | 8.2 | 7.5 | 30.8 | 4.3 | 33.0 | <2 |
| 21-Jan-17 | 9.3 | 8.9 | 9.8 | 4.1 | 4.0 | <2 |
| 23-Jan-17 | 9.8 | 8.7 | 11.1 | 4.8 | 9.0 | <2 |
| 25-Jan-17 | 8.8 | 7.6 | 24.3 | 4.1 | 19.0 | <2 |
| 27-Jan-17 | 6.0 | 7.9 | 25.6 | 7.4 | 25.5 | 8.0 |

[#] Additional water quality monitoring at the exceeded location(s) due to two consecutive monitoring days indicated Limit Level exceedance.



Table 6-3 Water Quality Monitoring Results Associated only Contract 6

| |] | Dissolved Oxygen | | | Turbidity | | | | Suspended Solids | | | |
|-----------|-------------|------------------|------|---------|-------------|-------------|--------|------------|------------------|-------------|------|-------------|
| Date | (mg/L) | | | (NTU) | | | (mg/L) | | | | | |
| | WM2A(a) | WM2A- Cx | WM2B | WM2B- C | WM2A (a) | WM2A- Cx | WM2B | WM2B- C | WM2A(a) | WM2A- Cx | WM2B | WM2 B- C |
| 3-Jan-17 | 8.2 | 8.0 | 8.6 | 6.9 | 15.4 | 8.4 | 7.3 | 1.7 | 12.5 | 4.5 | 10.5 | 2.0 |
| 5-Jan-17 | 7.7 | 7.7 | 8.4 | 6.8 | 19.0 | 12.0 | 8.4 | 5.1 | 14.5 | <2 | 7.0 | <2 |
| 7-Jan-17 | 7.9 | 7.7 | 8.7 | 7.2 | 8.5 | 9.4 | 3.6 | 3.0 | 4.0 | <2 | 3.0 | 2.5 |
| 10-Jan-17 | 7.6 | 7.8 | 9.0 | 7.2 | 21.6 | 15.1 | 7.2 | 4.0 | 14.0 | 3.0 | 2.5 | <2 |
| 12-Jan-17 | 7.6 | 7.4 | 8.8 | 7.2 | 11.9 | 9.9 | 8.8 | 3.6 | 7.0 | 3.0 | 10.0 | <2 |
| 14-Jan-17 | 8.2 | 8.5 | 9.2 | 7.5 | 7.9 | 10.6 | 6.8 | 3.0 | 7.0 | 2.0 | 3.5 | <2 |
| 17-Jan-17 | 8.3 | 8.2 | 8.6 | 7.4 | 9.7 | 15.5 | 7.4 | 3.3 | 6.0 | 4.0 | 9.5 | <2 |
| 19-Jan-17 | 7.9 | 7.8 | 7.6 | 6.4 | 12.8 | 13.6 | 11.3 | 4.8 | 10.0 | 4.0 | 10.5 | <2 |
| 21-Jan-17 | 8.3 | 8.2 | 8.5 | 7.5 | 11.7 | 11.9 | 7.2 | 6.1 | 14.5 | <2 | 3.5 | <2 |
| 23-Jan-17 | 9.0 | 8.9 | 9.1 | 7.6 | 12.7 | 10.8 | 7.6 | 3.4 | 12.0 | <2 | 11.5 | <2 |
| 25-Jan-17 | 8.0 | 7.9 | 8.2 | 7.5 | 21.6 | 12.3 | 4.9 | 2.4 | 14.0 | 2.0 | 8.0 | <2 |
| 27-Jan-17 | 8.1 | 7.8 | 8.8 | 7.5 | 9.3 | 12.3 | 3.8 | 2.8 | 7.5 | <2 | 3.5 | <2 |

Table 6-4 Water Quality Monitoring Results Associated Contracts 2 and 6

| Date | Dissolved Oxygen (mg/L) | | | oidity ΓU) | Suspended Solids (mg/L) | | |
|-----------|----------------------------|-------|------|---------------|----------------------------|-------|--|
| | WM3x | WM3-C | WM3x | WM3-C | WM3x | WM3-C | |
| 3-Jan-17 | 7.4 | 7.0 | 7.1 | 5.3 | 12.5 | 29.0 | |
| 5-Jan-17 | 7.4 | 6.6 | 9.4 | 7.9 | 3.5 | <2 | |
| 7-Jan-17 | 7.2 | 7.5 | 5.1 | 4.6 | 2.5 | <2 | |
| 10-Jan-17 | 8.1 | 7.0 | 5.0 | 6.0 | 3.5 | 9.0 | |
| 12-Jan-17 | 7.5 | 7.0 | 10.7 | 2.8 | 4.0 | <2 | |
| 14-Jan-17 | 8.7 | 7.9 | 12.9 | 2.6 | 11.0 | 3.0 | |
| 17-Jan-17 | 7.6 | 6.9 | 4.4 | 3.3 | 4.0 | 5.0 | |
| 19-Jan-17 | 7.1 | 7.0 | 7.5 | 1.8 | 9.0 | <2 | |
| 21-Jan-17 | 8.0 | 6.9 | 13.0 | 5.6 | 12.0 | 3.5 | |
| 23-Jan-17 | 8.2 | 7.5 | 10.6 | 3.8 | 12.5 | 5.0 | |
| 25-Jan-17 | 8.3 | 6.5 | 13.3 | 3.7 | 12.5 | 8.0 | |
| 27-Jan-17 | 8.1 | 7.4 | 2.7 | 2.7 | <2 | 3.0 | |

Table 6-5 Action and Limit (A/L) Levels Exceedance Recorded

| Location | | olved ygen | Turb | oidity | _ | ended lids | | otal edance | - | t Related edance |
|---------------------|----|---------------|---------------|--------|---------------|---------------|---------------|----------------|----|---------------------|
| | AL | LL | \mathbf{AL} | LL | \mathbf{AL} | LL | \mathbf{AL} | LL | AL | LL |
| WM1 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| WM2A(a) | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| WM2B | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| WM3x | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| WM4 | 0 | 0 | 0 | 1 | 0 | 1 | 0 | 2 | 0 | 0 |
| No of Exceedance | 0 | 0 | 0 | 1 | 0 | 1 | 0 | 2 | 0 | 0 |

- 6.2.3 In this Reporting Period, a total of two (2) Limit Level (LL) exceedances, namely one (1) LL exceedance of turbidity and one (1) LL exceedances of Suspended Solids were recorded for the Project and they are summarized in *Table 6-5*. According to the investigation result, all exceedances were concluded as non-project related.
- 6.2.4 NOE was issued to relevant parties upon confirmation of the monitoring result. The investigation results and summary of exceedances are summarized in *Table 6-6*. The details of the completed investigation reports for the exceedances are attached in *Appendix N*.



 Table 6-6
 Summary of Water Quality Exceedance in the Reporting Period

| Date of Exceedance | Location | Exceeded Parameter | Cause of Water Quality Exceedance In Brief |
|-----------------------|--------------------|-----------------------|--|
| 21 Jan 2017 | WM4 (C2 and C3) | NTU &SS | During weekly site inspection at South Portal of Contract 2, it was observed the wastewater treatment facility implemented on site was function properly and the treated water to be discharge was visually clear. The site condition was generally in order and no adverse water quality impacts and abnormal situation under the Contract were identified. Moreover, there was no rain recorded on 21 January 2017 and runoff from the site was unlikely to occur. In our investigation, it is considered that exceedances were due to natural variation and unlikely related to the works under the Contract. During weekly site inspection by ET at Contracts 3 in January 2017, it was observed that no excessive wastewater was generated from the active construction works and the water quality in the existing river channel adjacent to the construction site was clear. The site condition was generally in order and no adverse water quality impacts and abnormal situation under the Contract were identified. Moreover, there was no rain recorded on 21 January 2017 and runoff from the site was unlikely to occur. In our investigation, it is considered that exceedances were due to natural variation and unlikely related to the works under the |
| | | | Contract 3. |



7 ECOLOGY MONITORING

7.1 GENERAL

7.1.1 Ecology monitoring for woodland compensation was shall be conducted at bi-monthly interval. The last ecological monitoring report (Nov-Dec 2016) was submitted to EPD in January 2017 and the next ecological monitoring report (Jan-Feb 2017) will be issued in next Reporting Period.



8 WASTE MANAGEMENT

8.1 GENERAL WASTE MANAGEMENT

8.1.1 Waste management was carried out in accordance with the Waste Management Plan (WMP) for each contract.

8.2 RECORDS OF WASTE QUANTITIES

- 8.2.1 All types of waste arising from the construction work are classified into the following:
 - Construction & Demolition (C&D) Material;
 - Chemical Waste;
 - General Refuse; and
 - Excavated Soil.
- 8.2.2 The quantities of waste for disposal in this Reporting Period are summarized in *Tables 8-1* and 8-2 and the Monthly Summary Waste Flow Table is shown in *Appendix L*. Whenever possible, materials were reused on-site as far as practicable.

Table 8-1 Summary of Quantities of Inert C&D Materials for the Project

| Type of | Cont | tract 2 | Cor | ntract 3 | Con | tract 6 | Co | ntract 7 | Contra | act SS C505 | Total |
|---|---------|---|-------|-------------------|--------|--|------|-------------------|--------|-------------------|----------|
| Waste | Qty. | Disposal location | Qty. | Disposal location | Qty. | Disposal location | Qty. | Disposal location | Qty. | Disposal location | Quantity |
| C&D Materials (Inert) (in '000m ³) | 59.9685 | | 1.150 | 1 | 39.926 | | 0 | | 3.16 | 1 | 104.2045 |
| Reused in this Contract (Inert) (in '000 m ³) | 0.4203 | | 0.150 | 1 | 19.095 | | 0 | | 2.003 | 1 | 21.6683 |
| Reused in other Contracts/ Projects (Inert) (in '000 m³) | 26.9277 | C6/ NENT# & other projects approved by the ER | 0 | | 6.067 | C5 & other projects approved by the ER | 0 | | 0 | | 32.9947 |
| Disposal as Public Fill (Inert) (in '000 m³) | 32.6205 | Tuen Mun 38 | 0.796 | Tuen Mun 38 | 14.764 | Tuen Mun 38 | 0 | | 1.157 | TKO 137 | 49.3375 |

Remark #: The C&D materials were delivered to NENT for reuse by laying cover of the landfilling area.

Table 8-2 Summary of Quantities of C&D Wastes for the Project

| | Cont | tract 2 | Cont | tract 3 | Con | tract 6 | Cont | ract 7 | Contract | SS C505 | Total |
|--|--------|--------------------|-------|--------------------|-------|-------------------|-------|--------------------|----------|--------------------|--------------|
| Type of Waste | Qty. | Disposal location | Qty. | Disposal location | Qty. | Disposal location | Qty. | Disposal location | Qty. | Disposal location | Quantity |
| Recycled Metal ('000kg)# | 9.6870 | Licensed collector | 0 | - | 0 | | 0.1 | Licensed collector | 458.150 | Licensed collector | 467.937 |
| Recycled Paper / Cardboard Packing ('000kg) # | 0.3000 | Licensed collector | 0 | - | 0 | | 0.05 | Licensed collector | 0.560 | Licensed collector | 0.91 |
| Recycled Plastic ('000kg)# | 2.3000 | Licensed collector | 0.001 | Licensed collector | 0 | | 0.001 | Licensed collector | 0.058 | Licensed collector | 2.359+#0.001 |
| Chemical Wastes ('000kg)# | 1.7600 | Licensed collector | 0 | - | 0 | | 0 | | 0 | | 1.76 |
| General Refuses ('000m³) | 0.1931 | NENT | 0.170 | NENT | 0.065 | NENT | 0.001 | NENT | 0.481 | NENT | 0.9101 |

Remark #: Unit of recycled metal, recycled paper/ cardboard packing, recycled plastic and chemical waste for Contract 3 was in ('000m³).



9 SITE INSPECTION

9.1 REQUIREMENTS

9.1.1 According to the approved EM&A Manual, the environmental site inspection shall be formulation by ET Leader. Weekly environmental site inspections should carry out to confirm the environmental performance.

9.2 FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH

Contract 2

- 9.2.1 In the Reporting Period, joint site inspection for Contract 2 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on **6**, **13**, **20** and **27** January **2017**. No non-compliance was noted.
- 9.2.2 The findings / deficiencies of *Contract 2* that observed during the weekly site inspection are listed in *Table 9-1*.

Table 9-1 Site Observations for Contract 2

| Date | Findings / Deficiencies | | Follow-Up Status | 3 |
|--------------------|--|---|------------------------|-----|
| 6 January 2017 | • No adverse environmental issue was observed. | • | NA | |
| 13 January 2017 | • No adverse environmental issue was observed. | • | NA | |
| 20 January 2017 | • It was reminded that mud and silt cumulated at wastewater storage area should be cleaned more frequently to prevent overflow. (Mid-Vent) | • | Not required reminder. | for |
| 27 January 2017 | • It was reminded that sediment cumulated inside the u-channel near the site should be | • | Not required reminder | for |
| | cleared. (Min-Vent) It was reminded that broken NRMM label should be replaced properly. (North Portal) | • | Not required reminder. | for |

Contract 3

- 9.2.3 In the Reporting Period, joint site inspection for Contract 3 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 3, 9, 18 and 23 January 2017. No non-compliance was noted.
- 9.2.4 The findings / deficiencies of *Contract 3* that observed during the weekly site inspection are listed in *Table 9-2*.

Table 9-2 Site Observations for Contract 3

| Date | Findings / Deficiencies | Follow-Up Status |
|-----------------|--|--|
| 3 January 2017 | To avoid surface water run-off entering the river, the Contractor should provide sandbag bund to prevent water run-off. (Location: Portal AD3) Free standing oil drums at pier AA3 was observed, the Contractor should provide drip tray for the oil drums to avoid leakage and land contamination. | Concrete blocks were provided to avoid surface water run-off entering the river. Free-standing oil drums was removed. |
| 9 January 2017 | No adverse environmental issue was observed. | • NA |
| 18 January 2017 | • Tree protection zone should be set up for | • Tree protection zone |



| Date | Findings / Deficiencies | Follow-Up Status |
|-----------------|---|---|
| | retaining trees, also construction materials storage near tree protection zone should be removed. (FH9) | was set up and construction materials was kept clear near the tree protection zone. |
| 23 January 2017 | Open stockpiles was observed at work area of SA 1. The contractor was advised to cover it with tarpaulin sheets. The contractor was reminded to dispose construction waste regularly at site area. | The stockpile was covered with tarpaulin sheets entirely Not required fo reminder. |

- 9.2.5 In the Reporting Period, joint site inspection for Contract 6 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on 5, 12, 19 and 26 January 2017. No non-compliance was noted.
- 9.2.6 The findings / deficiencies of *Contract 6* that observed during the weekly site inspection are listed in *Table 9-4*.

Table 9-4 Site Observations for Contract 6

| Date | Findings / Deficiencies | Follow-Up Status |
|--------------------|--|---|
| 5 January 2017 | • Seepage of vehicle wash water was observed near Bridge Y. The Contactor should take measure to ensure no seepage of the vehicle wash water into the river body. | The gap of the temporary bridge has been sealed up. |
| 12 January 2017 | • Immediate follow-up action was taken by the Contractor after the turbid water has been observed at the discharge outfall. The Contractor should further enhance of waste water treatment facility and to ensure the water quality of discharge water fulfils with the requirements of WPCO. (Location: Bridge Y) | Wastewater treatment process was further enhanced and the effluent of the treated water was visually clear. |
| 19 January 2017 | No adverse environmental issue was observed. | • NA |
| 26 January 2017 | Exposed stockpile at Bridge D was observed, the Contractor should provide mitigation measures to prevent dust generation from the stockpile. | • The stockpile soil has been covered entirely with imperious sheet for dust emission control. |

Contract SS C505

- 9.2.7 In the Reporting Period, joint site inspection for Contract SS C505 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on **5**, **11**, **18 and 23 January 2017.** No non-compliance was noted.
- 9.2.8 The findings / deficiencies of *Contract SS C505* that observed during the weekly site inspection are listed in *Table 9-5*.

Table 9-5 Site Observations for Contract SS C505

| Date | Findings / Deficiencies | Follow-Up Status |
|-----------|--|---|
| 5 January | • Stagnant water was observed at the bottom of PTB and at Building 36. The | Stagnant water was removed at the bottom of |



| Date | Findings / Deficiencies | Follow-Up Status |
|--------------------|--|--|
| 2017 | Contractor should remove the stagnant water to prevent mosquito breeding. | PTB. Water pump was provided and stagnant water was removed. |
| | Construction material mixed with general refuse was observed at PTB. The Contractor should sort out the general refuse and place them into waste skip. | General refuse was removed. |
| 11 January 2017 | Open stockpiles was observed at work area of building 1-3. The contractor was advised to cover stockpiles with tarpaulin sheet to avoid dust emission. | Stockpile was covered with tarpaulin sheet. |
| | • Stagnant water was observed at work area of prototype C. The contractor was advised to clean the stagnant water to prevent mosquito breeding. | • Stagnant water was removed at the work area of prototype C. |
| 18 January 2017 | Stagnant water was observed at PTB and at drainage channel near Building 3. The Contractor should remove the stagnant water to prevent mosquito breeding. | • Water pump was provided stagnant water removal at PTB and sediment removal work was carried out at drainage channel near Building 3. |
| 23 January 2017 | Chemical containers without drip tray were observed near PTB. The Contractor should place the containers into drip tray to prevent land contamination. | Chemical containers were placed into drip tray. |

- 9.2.9 In the Reporting Period, joint site inspection for Contract 7 to evaluate the site environmental performance has been carried out by the RE, IEC, ET and the Contractor on **3, 10, 17 and 24 January 2017**. No non-compliance was noted.
- 9.2.10 The findings / deficiencies of *Contract* 7 that observed during the weekly site inspection are listed in *Table 9-6*.

Table 9-6 Site Observations for Contract 7

| Date | Findings / Deficiencies | es Follow-Up Status | | |
|-----------------|--|--|--|--|
| 3 January 2017 | No adverse environmental issue was observed. | • NA | | |
| 10 January 2017 | No adverse environmental issue was observed | • NA | | |
| 17 January 2017 | Exposed Slope was observed at Bridge A, the Contractor should cover the slope to prevent surface run-off and dust generation. Free standing chemical containers at Bridge B, the Contractor should provide drip tray for the chemical containers. | The exposed slope has been covered entirely. The chemical containers were removed from site. | | |
| 24 January 2017 | Oil drum without drip tray was observed. Drip tray should be provided for all chemical storage on site. Excavator missing NRMM label was observed. Proper label should be displayed. | The oil drum is removed from site. The NRMM label is provided and displayed at the excavator. | | |



9.2.11 General housekeeping such as daily site tidiness and cleanliness should be maintained for all Contracts. Furthermore, the Contractors were reminded to implement Waste Management Plan of the Project.

Other Contracts

9.2.12 Since the construction work of Contract 5 has substantially completed and Contract 4 has not commenced, no site inspection was performed.



10 ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE

10.1 ENVIRONMENTAL COMPLAINT, SUMMONS AND PROSECUTION

10.1.1 In the Reporting Period, no summons and prosecution under the EM&A Programme was lodged for all Contracts. However, a total of three (3) documented environmental complaints were received all regarding to water quality aspect, in which two (2) complaints were related to Contract 2 and the other one was related to both Contracts 2 and 6. The investigation results are presented below.

<u>Investigation Result for the Documented Complaints by 1823 on 16 January 2017</u> (Contracts 2 and 6)

- 10.1.2 A complaint was received from 1823 on 16 January 2017 regarding muddy water found on the ground near the traffic light post at the junction of Sha Tau Kok (STK) Road and Wo Keng Shan (WKS) Road and it was suspected the muddy water was come from the construction site. The cumulated muddy water splashed on the pedestrian when vehicle passing by which causing inconvenience to the public and the complainant requested the related department to follow up.
- 10.1.3 Joint site inspection was carried out by RE, IEC, Contractors and ET on 19 and 20 January 2017 at the suspected four (4) site exits along the Sha Tau Kok Road and Wo Keng Shan Road and the traffic light post for the complaint investigation. The aim of the inspection was to examine the condition of the existing site exit and the implementation the wheel washing facilities and to assess the possibility of muddy water discharge out of the construction site to the public road. The observations during the site inspection are summarized in below.

North Portal under Contract 2

10.1.4 Site inspection was conducted on 20 January 2017 at the concerned site exit SA18 of North Portal under Contract 2 on Sha Tau Kok Road. It was observed that wheel washing facilities were provided within the construction site and each dump truck was thoroughly cleaned by wheel washing facility and water dripping from the truck was cleaned before leaving SA18. Moreover, cut-off drain, sump pit and pump were in place at SA18 to prevent any muddy water discharging to STK road. As advised by the Contractor of Contact 2 (DHK), WKS road and STK road were cleaned regularly by water wagon. According to the investigation on 20 January 2017, the condition of the site exit was clean and satisfactory and no trails of mud and muddy water were observed on the adjacent Sha Tau Kok Road.

Proposed Sha Tau Kok Interchange under Contract 6

10.1.5 Site inspection was conducted on 19 January 2017. The site exit of proposed Sha Tau Kok Interchange under Contract 6 was located at the junction of Sha Tau Kok Road and Wo Keng Shan Road. Wheel washing facilities was properly implemented at the site exit and the area between the wheel washing bay and site exit was hard paved. No trails of mud and muddy water were observed on the adjacent Sha Tau Kok Road and Wo Keng Shan Road.

Traffic light post at junction of Tau Kok Road and Wo Keng Shan Road

10.1.6 The concerned traffic light post mentioned by the complainant was located at junction of Tau Kok Road and Wo Keng Shan Road. During site inspection on 19 January 2017, no muddy water and mud trails were observed at the traffic light post and adjoin public roads.

Wo Keng Shan Park under Contract 6

10.1.7 Site inspection was conducted on 19 January 2017. The site exit of Wo Keng Shan Park under Contract 6 was located on Wo Keng Shan Road. Wheel washing facilities was properly implemented at the site exit and the area between the wheel washing bay and site exit was hard paved. No trails of mud and muddy water were observed on the adjacent Wo Keng Shan Road.

South Portal and Site Office under Contract 6

10.1.8 Site inspection was conducted on 19 January 2017. The site exit of South Portal and Site Office under Contract 6 was located on Wo Keng Shan Road. Wheel washing facilities was properly



implemented at the site exit and the area between the wheel washing bay and site exit was hard paved. No trails of mud and muddy water were observed on the adjacent Wo Keng Shan Road.

10.1.9 As advised by both contractors, road washing/ cleaning by water bowsers was provided along Wo Keng Shan Road to Sha Tau Kok Road in every normal working day (Mon-Sat), except for rainy day. Moreover, road sweeping would be provided for the concerned roads twice a week to maintain cleanliness of the roads. In our investigation, no cumulated muddy water and mud trails were observed and the site exits near the complaint location were satisfactory. It is considered that the complaint was unlikely due to the project. To address the complainant's concern, the ET will keep closely inspection on the cleanliness situation on both roads during weekly site inspection.

<u>Investigation Result for the Documented Complaint by DSD on 3 January 2017 (Contract 2)</u>

- 10.1.10 DSD conducted site inspection on 3 January 2017 at Kwan Tei River near Po Kak Tsai and suspected construction foul water was found in the branch of Kwan Tei River. Subsequent site inspection in Kwan Tei River was conducted by DSD and EPD on 6 and 10 January 2017 respectively for further investigation. According to DSD's inspection report, a discharge of slurry had smothered Kwan Tei River and wiped out the Firefly trial site which was meant to be a showcase of river health and the return of diverse freshwater life in the region. On EPD's inspection on 10 January 2017, it revealed that the open channel which received discharge from the construction site was accumulated with slurry. According to the inspection records from DSD and EPD, the source of foul water was suspected to be construction site of Mid-Vent under Contract 2.
- 10.1.11 Joint site inspection among the RE, IEC, Contractor of Contract 2 (DHK) and ET was carried out on 13 January 2017 in Mid-vent and Kwan Tei River for the complaint investigation. The observations during site inspection are summarized below.
 - (a) Wastewater treatment facility was implemented at construction site of Mid-vent. It comprises of 5 nos. of sedimentation tanks, 3 nos. of de-silting pit, a WetSep and an AquaSed. The treated water was stored in the recycle water silo and discharge would be made when the water silo is full.
 - (b) There was discharge made from the Mid-vent during the site inspection and it was observed that the quality of discharge was visually clear.
 - (c) In view of the current site condition, the majority of wastewater was generated from the tunnelling works. The wastewater generated in the tunnel was pumped to the wastewater treatment facility for proper treatment prior discharge at the approved discharge point.
 - (d) During the inspection carried out along Kwan Tei River, it was observed that the existing water flowing in the river channel was visually clear. However, part of the river and channel bed was cumulated with silt and sediment, suspecting caused by the emergency discharge from DHK. DHK agreed to clean up the relevant channel as appropriated.
- 10.1.12 According to the incident report by DHK, in the morning of 28 December 2016 (at around 10:15am), a staff at Mid-vent worksite observed flooding of the Adit and water was flowing rapidly into the Adit and he realized that the 6" pump in Desilting Tank 3 was not working. To avoid flooding inside the tunnel which may cause danger to the safety of the people working inside the Adit, the staff of DHK switched on the emergency pump without informing the senior management of the site. The emergency pump was activated for about 15 minutes till 10:30am when AECOM observed muddy water discharge and instructed DHK to stop such discharge. On 28 and 29 December 2016, DHK had started removing silt deposited in the surface channels as well as those sections along stream that were accessible.
- 10.1.13 On 5 January 2017, AECOM received a complaint from DSD about silt deposit along the stream leading to Kwan Tei River. On 6 and 7 January 2016, DHK has arranged by 9 suction truck trips to clean the upper section of the stream. DSD issued another e-mail and mentioned the



firefly issue on 10 January 2017. In view of the sensitivity of the site, a cleaning proposal was prepared by DHK to determine the affected area to be cleaned and method for the cleaning works and the proposal was agreed by DSD on 16 January 2017. The cleansing works was commenced on 17 January 2017 and completed by 27 January 2017 according to the agreed proposal. (Photo 13 to 16) A joint site inspection with DSD was conducted on 3 February 2017. Further minor clean up was agreed with DSD and re-inspection was arranged on 8 February 2017. DSD had no further comment on the final inspection carried out on 8 February 2017.

- 10.1.14 To avoid recurrent, further actions to be carried out by DHK were mentioned in the incident report, such as installation of sand trap as requested by DSD and additional monitoring point as requested by EPD and management of emergency situation by DHK. It also stressed that apart from the remedial actions that have been implemented after the incident, DHK has strengthened the management of flooding situation on Site. Only Construction Manager or above are involved in the decision-making and on top of that Project Management, AECOM and CEDD must be report of such decision.
- 10.1.15 In our investigation, it is considered that the complaint was caused by the inadvertent and unintentional emergency discharge by DHK in their consideration of safety of the people working inside the Adit. To maintain the wastewater water system, DHK has already increased to the frequency of sludge removal of the wastewater treatment facility to 3-5 times daily to reduce the load of the water pump. In our response to the complaint, DHK was advised that replacement by spare water pump should be made immediately when any malfunction event is alerted. Moreover, additional measures for flood control such as additional retention tanks or flood gates were recommended. In case of any emergence discharge, DHK should immediately clean up the deposition at the downstream channel to avoid water contamination spreading further downstream.
- 10.1.16 As requested by EPD, AECOM has discussed with ET and IEC regarding the suggestion from EPD to provide an additional water quality monitoring station. Finally, ET will keep closely monitor the site condition and status of implemented mitigation measures by DHK in weekly site inspection.

<u>Investigation Result for the Documented Complaint received by EPD on 25 January 2017</u> (Contract 2)

- 10.1.17 The complaint is under investigation under ET and it will be reported in next Reporting Period.
- 10.1.18 Upon receipt of the complaint, follow up action has been undertaken by both Contractor promptly to resolve the complaints and deficiencies. During the complaint investigation work, the Contractor was co-operated with the ET in providing all the necessary information and assistance for completion of the investigation. Investigation report for the complaints on 3 and 16 January 2017 has been submitted to all relevant parties for review.
- 10.1.19 The statistical summary table of environmental complaint is presented in *Tables 10-1*, *10-2* and *10-3*.

Table 10-1 Statistical Summary of Environmental Complaints

| Contract | | Envi | Project | | |
|------------------------------|-------------------------|------|------------|------------------|------------------------------------|
| Reporting Period | Period Contract No Free | | Cumulative | Complaint Nature | related complaint |
| 19 May 2014 – 31 Dec 2016 | Contract 2 | 0 | 23 | • (2) Noise | (3) water (2) dust (1) noise |



| | Contract | Envi | ronmental Co | mplaint Statistics | Project |
|------------------------------|------------|-----------|--------------|--|---------------------------------------|
| Reporting Period | No | Frequency | Cumulative | Complaint Nature | related complaint |
| 06 Nov 2013 – 31 Dec 2016 | Contract 3 | 0 | 4 | (1) Dust(2) Water quality(1) Noise | 0 |
| 16 Aug 2013 – 31 Dec 2016 | Contract 5 | 0 | 4 | • (3) Dust • (1) Noise | 0 |
| 16 Aug 2013 – 31 Dec 2016 | Contract 6 | 0 | 29 | (21) Water Quality (6) Dust (1) Noise (1) Nuisance | (6) water (2) dust (1) Nuisance |
| 15 Feb 2016 – 31 Dec 2016 | Contract 7 | 0 | 1 | • (1) Noise | NA |
| 16 Aug 2013 – 31 Dec 2016 | SS C505 | 0 | 2 | • (1) Noise • (1) dust | 0 |
| | Contract 2 | 3 (*) | 26 | (15)Water Quality (7) Dust (2) Noise (1) dust & noise | (1) water (#) |
| 1 21 I 2017 | Contract 3 | 0 | 4 | (1) Dust(2) Water quality(1) Noise | 0 |
| 1 – 31 Jan 2017 | Contract 6 | 1 (*) | 30 | (22) Water Quality (6) Dust (1) Noise (1) Nuisance | 0 |
| | Contract 7 | 0 | 1 | • (1) Noise | 0 |
| | SS C505 | 0 | 2 | • (1) Noise • (1) dust | 0 |

Remark (#): One (1) environmental complaint in the reporting report is under investigation. (*): One complaint is related to both Contracts 2 and 6.

 Table 10-2
 Statistical Summary of Environmental Summons

| D | Caratara at Na | E | Environmental Summons Statistics | | | |
|------------------------------|----------------|-----------|---|------------------|--|--|
| Reporting Period | Contract No | Frequency | Cumulative | Complaint Nature | | |
| 19 May 2014 – 31 Dec 2016 | Contract 2 | 0 | 0 | NA | | |
| 06 Nov 2013 – 31 Dec 2016 | Contract 3 | 0 | 0 | NA | | |
| 16 Aug 2013 – 31 Dec 2016 | Contract 5 | 0 | 0 | NA | | |
| 16 Aug 2013 – 31 Dec 2016 | Contract 6 | 0 | 0 | NA | | |
| 15 Feb 2016 – 31 Dec 2016 | Contract 7 | 0 | 0 | NA | | |
| 16 Aug 2013 – 31 Dec 2016 | SS C505 | 0 | 0 | NA | | |
| | Contract 2 | 0 | 0 | NA | | |
| | Contract 3 | 0 | 0 | NA | | |
| 1 – 31 Jan 2017 | Contract 6 | 0 | 0 | NA | | |
| | Contract 7 | 0 | 0 | NA | | |
| | SS C505 | 0 | 0 | NA | | |



Table 10-3 Statistical Summary of Environmental Prosecution

| Domontino Dominal | Cantua et No | Environmental Prosecution Statistics | | | |
|------------------------------|--------------|--------------------------------------|------------|------------------|--|
| Reporting Period | Contract No | Frequency | Cumulative | Complaint Nature | |
| 19 May 2014 – 31 Dec 2016 | Contract 2 | 0 | 0 | NA | |
| 06 Nov 2013 – 31 Dec 2016 | Contract 3 | 0 | 0 | NA | |
| 16 Aug 2013 – 31 Dec 2016 | Contract 5 | 0 | 0 | NA | |
| 16 Aug 2013 – 31 Dec 2016 | Contract 6 | 0 | 0 | NA | |
| 15 Feb 2016 – 31 Dec 2016 | Contract 7 | 0 | 0 | NA | |
| 16 Aug 2013 – 31 Dec 2016 | SS C505 | 0 | 0 | NA | |
| | Contract 2 | 0 | 0 | NA | |
| | Contract 3 | 0 | 0 | NA | |
| 1 – 31 Jan 2017 | Contract 6 | 0 | 0 | NA | |
| | Contract 7 | 0 | 0 | NA | |
| | SS C505 | 0 | 0 | NA | |

The Other Contracts

Since the construction works at the Contract 5 was substantially completed and Contract 4 has not yet commenced, no environmental complaint, summons and prosecution under the EM&A Programme are registered in the Reporting Period.



11 IMPLEMENTATION STATUS OF MITIGATION MEASURES

11.1 GENERAL REQUIREMENTS

- The environmental mitigation measures that recommended in the Implementation Schedule for Environmental Mitigation Measures (ISEMM) in the approved EM&A Manual covered the issues of dust, noise, water and waste and they are summarized presented in *Appendix M*.
- All contracts under the Project shall be implementing the required environmental mitigation measures according to the approved EM&A Manual as subject to the site condition. Environmental mitigation measures generally implemented by Contracts 2, 3, 5, 6, 7 and Contract SS C505 in this Reporting Period are summarized in *Table 11-1*.

Table 11-1 Environmental Mitigation Measures

| Issues | Environmental Mitigation Measures |
|-------------|---|
| Water | • Wastewater to be treated by the wastewater treatment facilities i.e. |
| Quality | sedimentation tank or similar facility before discharge. |
| Air Quality | Maintain damp / wet surface on access road |
| | Low vehicular speed within the works areas. |
| | All vehicles must use wheel washing facility before off site |
| | Sprayed water during breaking works |
| | • A cleaning truck was regularly performed on the public road to prevent |
| | fugitive dust emission |
| Noise | • Restrain operation time of plants from 07:00 to 19:00 on any working day |
| | except for Public Holiday and Sunday. |
| | Keep good maintenance of plants |
| | Place noisy plants away from residence or school |
| | Provide noise barriers or hoarding to enclose the noisy plants or works |
| | Shut down the plants when not in used. |
| Waste and | On-site sorting prior to disposal |
| Chemical | Follow requirements and procedures of the "Trip-ticket System" |
| Management | Predict required quantity of concrete accurately |
| | • Collect the unused fresh concrete at designated locations in the sites for |
| | subsequent disposal |
| General | The site was generally kept tidy and clean. |

11.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH

11.2.1 As advised by the ER, the construction works under Contract 5 was substantially completed on 31 August 2016. Construction activities for other Contracts in the coming month are listed below:

| Contract 2 | |
|-----------------|--|
| Mid-Vent Portal | Stud tunnel D&B excavation |
| | preparation for TBM South drive breakthrough |
| | Adit invert slab, water proofing and lining |
| | Connecting structure and ventilation building superstructure works |
| North Portal | Northbound tunnel bench mechanical excavation |
| | Southbound TBM excavation |
| | Southbound tunnel excavation by TBM |
| | Construction of cross passage and internal structure |
| | Retaining walls and slope stabilizations |
| | North ventilation building superstructure |
| South Portal | Southbound and Northbound D&B excavation |
| | South ventilation building superstructure |
| | Tunnel invert, waterproofing and lining |
| Admin Building | • Construction of superstructure, permanent drainage, external wall, |
| _ | internal fitting out and curtain wall installation |



- Boundary Wall for Pumping Station
- Abutment construction
- Cable detection and trial trenches
- Construction of Remaining Slab of Box Culvert ID04
- Demolition of Existing Kiu Tau Vehicular Bridge
- Extended Podium construction
- Gabion wall construction
- Installation of noise barrier steel column and panel
- Re-provisioning of Kiu Tau Footbridge
- Storm drains laying
- Noise barrier construction
- Pier / Pier Table construction
- Pipe jacking works for DN220 water mains
- Portal construction
- Profile barrier construction on viaduct
- Retaining Wall construction
- Road works
- Roundabout modification works
- Sewer works
- Slope reinstatement works near Bridge E
- Utilities duct laying
- Viaduct segment erection
- Water Main Laying

Contract 6

- Bored Piling
- Pile Cap Construction
- Bridge Pier Construction
- Segment section
- Sewage Treatment Plant Construction
- Tunnel Works

Contract 7

- U-trough construction at Bridge A and Bridge E
- Pile caps construction at Bridge A and E
- Column construction at Bridge B and D
- 2nd and 3rd floor construction of Bridge C

Contract SS C505

- Building no. 4, 5, 6, 7, 8, 9, 10, 11, 12, 13 and 36 construction
- Excavation for drainage works for Building no. 4, 5, 6 and 7
- On Grade Slab construction for Building no. 36
- Tower crane operation
- Bridge construction works including construction of bridge column, retaining wall, pile cap and pier
- Underground drainage works
- Formwork and falsework for PTB's slab construction
- Construction PTB M/F & 1/F flat slab
- Steel beam works for maintenance platform for PTB
- Pile cap construction for PTB, including excavation and backfilling works
- Bridge deck construction for Bridges 1 5



11.3 KEY ISSUES FOR THE COMING MONTH

- 11.3.1 Key issues to be considered in the coming month for Contracts 2, 3, 6, 7 and SS C505 include:
 - Implementation of control measures for rainstorm;
 - Regular clearance of stagnant water during wet season;
 - Implementation of dust suppression measures at all times;
 - Potential wastewater quality impact due to surface runoff;
 - Potential fugitive dust quality impact due from the dry/loose/exposure soil surface/dusty material;
 - Disposal of empty engine oil containers within site area;
 - Ensure dust suppression measures are implemented properly;
 - Sediment catch-pits and silt removal facilities should be regularly maintained;
 - Management of chemical wastes;
 - Discharge of site effluent to the nearby wetland, stockpiling or disposal of materials, and any dredging or construction area at this area are prohibited;
 - Follow-up of improvement on general waste management issues; and
 - Implementation of construction noise preventative control measures
- 11.3.2 Since the construction work of Contract 4 has not commenced, no environmental issue is presented.



12 CONCLUSIONS AND RECOMMENDATIONS

12.1 CONCLUSIONS

- 12.1.1 This is the **42nd** monthly EM&A report presenting the monitoring results and inspection findings for the Reporting Period from **1** to **31 January 2017**.
- For air quality monitoring, no 1-hour and 24-hour TSP monitoring results triggered the Action or Limit Levels were recorded. No NOEs or the associated corrective actions were therefore issued.
- 12.1.3 In the Reporting Period, no construction noise measurement results that exceeded the Limit Level were recorded. Moreover, no valid noise complaint which triggered an Action Level exceedance was recorded.
- 12.1.4 For water quality monitoring, two (2) LL exceedances, namely one (1) LL exceedance of turbidity and one (1) LL exceedances of Suspended Solids were recorded at WM4. According to the investigation result, all exceedances were concluded as not related to the works under the Project.
- 12.1.5 No environmental summons or successful prosecutions were recorded in the Reporting Period.
- 12.1.6 In this Reporting Period, a total of three (3) documented environmental complaints were received which all regarding to water quality aspect, in which two (2) complaints were related to Contract 2 and the other one was related to both Contracts 2 and 6. Investigation reports for two of the complaints were completed and submitted to relevant parties and the other one is under investigation.
- During the Reporting Period, weekly joint site inspection by the RE, IEC, ET with the relevant Main-contractor were carried out for Contracts 2, 3, 6, 7 and SS C505 in accordance with the EM&A Manual stipulation. No non-compliance observed during the site inspection.


12.2 RECOMMENDATIONS

- During dry season, special attention should be paid on the potential construction dust impact since most of the construction sites are adjacent to villages. The Contractor should fully implement the construction dust mitigation measures properly.
- 12.2.2 Preventive measures for muddy water or other water pollutants from site surface flow to local stream such as Kong Yiu Channel, Ma Wat Channel, Ping Yuen River or public area should be properly maintained. The Contractors should paid special attention on water quality mitigation measures and fully implement according ISEMM of the EM&A Manual, in particular for working areas near Ma Wat Channel and Ping Yuen River. Moreover, all effluent discharge shall be ensure to fulfill Technical Memorandum of Effluent Discharged into Drainage and Sewerage Systems, inland and Coastal Waters criteria or discharge permits stipulation.
- 12.2.3 Construction noise would be a key environmental issue during construction work of the Project. Noise mitigation measures such as using quiet plants should be implemented in accordance with the EM&A requirement.
- Furthermore, daily cleaning and weekly tidiness shall be properly performed and maintained. In addition, mosquito control should be kept to prevent mosquito breeding on site.



Appendix A

Layout plan of the Project

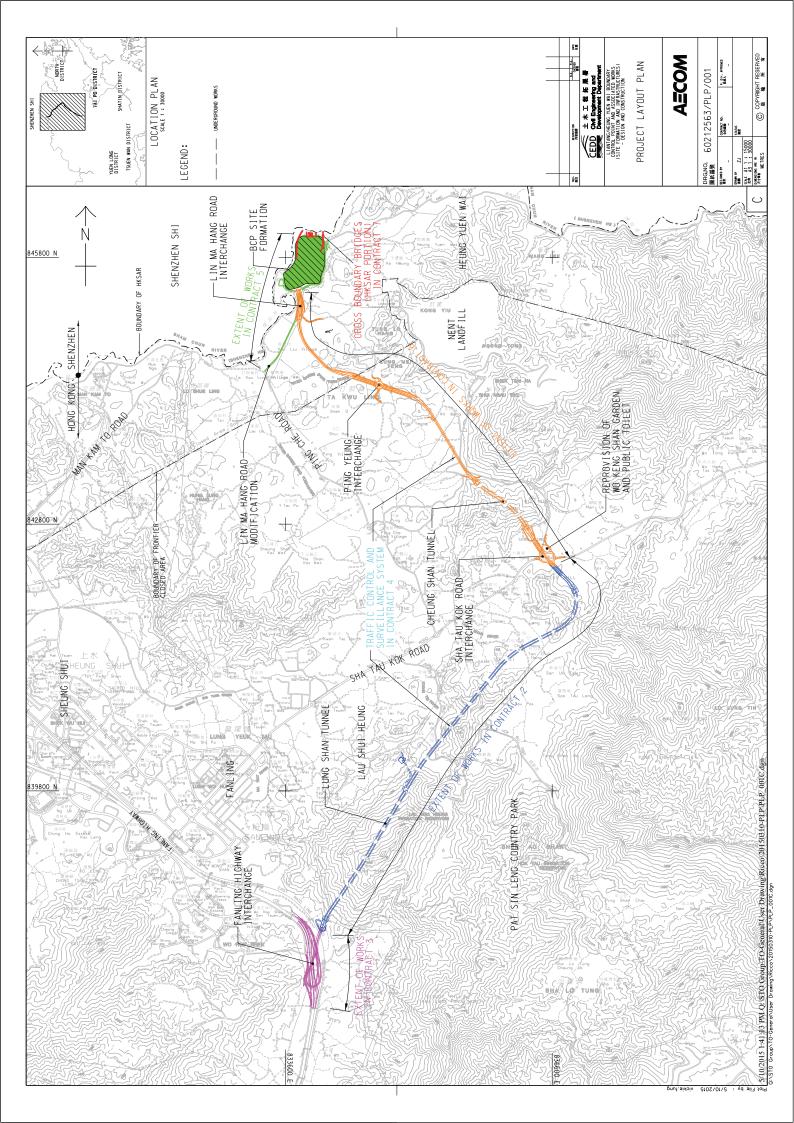




Appendix B

Organization Chart



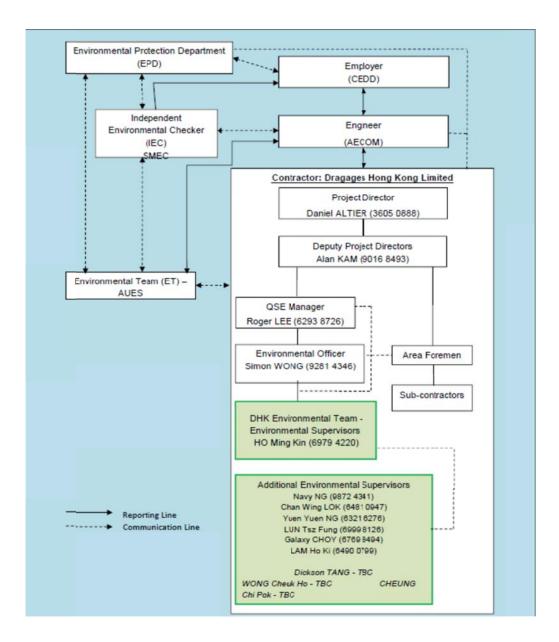

Environmental Management Organization for Contract 2 - (CV/2012/08)



Contact Details of Key Personnel for Contract 2 - CV/2012/08

| Organization | Project Role | Name of Key Staff | Tel No | Fax No. |
|--------------|--------------------------------------|-------------------|-----------|-----------|
| AECOM | Engineer's Representative | CT Wong | 2171 3300 | 2171 3498 |
| SMEC | Independent Environmental Checker | Antony Wong | 3995 8120 | 3995 8101 |
| DHK | Project Director | Daniel Altier | 3605 0888 | 2171 3299 |
| DHK | Deputy Project Manager | Alan Kam | 9016 8493 | 2171 3299 |
| DHK | QSE Manager | Roger Lee | 6293 8726 | 2171 3299 |
| DHK | Environmental Officer | Simon Wong | 2171 3004 | 2171 3299 |
| DHK | Environmental Supervisor | Ho Ming Kin | 6979 4220 | 2171 3299 |
| AUES | Environmental Team Leader | T. W. Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Nicola Hon | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Ben Tam | 2959 6059 | 2959 6079 |

Legend:


CEDD (Employer) - Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

DHK(Main Contractor) -Dragages Hong Kong Ltd.

SMEC (IEC) – SMEC Asia Limited



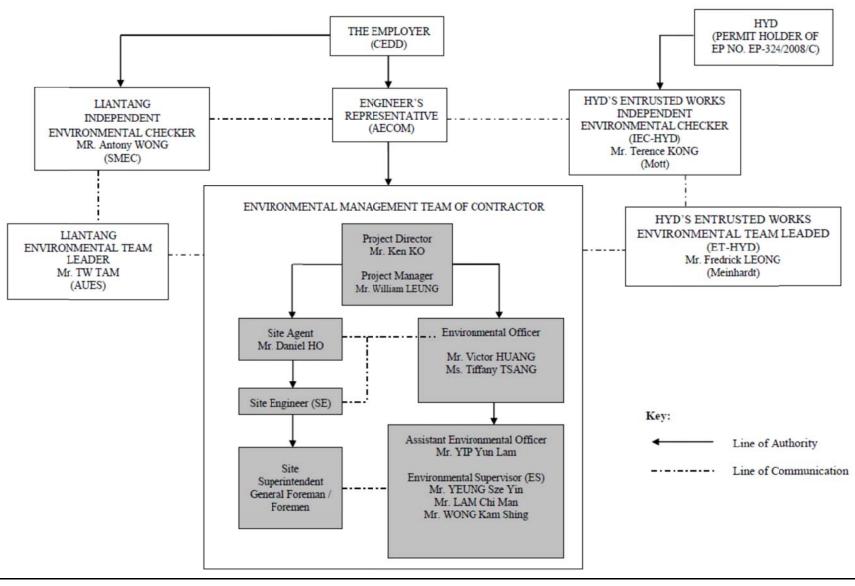

Environmental Management Organization for Contract 3 - CV/2012/09



Contact Details of Key Personnel for Contract 3 - CV/2012/09

| Organization | Project Role | Name of Key Staff | Tel No | Fax No. |
|--------------|--------------------------------------|-------------------------------|-----------|-----------|
| AECOM | Engineer's Representative | Alan Lee | 2171 3300 | 2171 3498 |
| SMEC | Independent Environmental Checker | Antony Wong | 3995 8120 | 3995 8101 |
| Chun Wo | Project Director | Ken Ko | 3758 8735 | 2638 7077 |
| Chun Wo | Project Manager | William Leung | 2638 6136 | 2638 7077 |
| Chun Wo | Site Agent | Daniel Ho | 2638 6144 | 2638 7077 |
| Chun Wo | Environmental Officer | Victor Huang Tiffany Tsang | 2638 6115 | 2638 7077 |
| Chun Wo | Assistant Environmental Officer | Yip Yun Lam | 2638 6125 | 2638 7077 |
| AUES | Environmental Team Leader | T. W. Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Nicola Hon | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Ben Tam | 2959 6059 | 2959 6079 |

Legend:


CEDD (Employer) - Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

Chun Wo (Main Contractor) – Chun Wo Construction Ltd.

SMEC (IEC) – SMEC Asia Limited



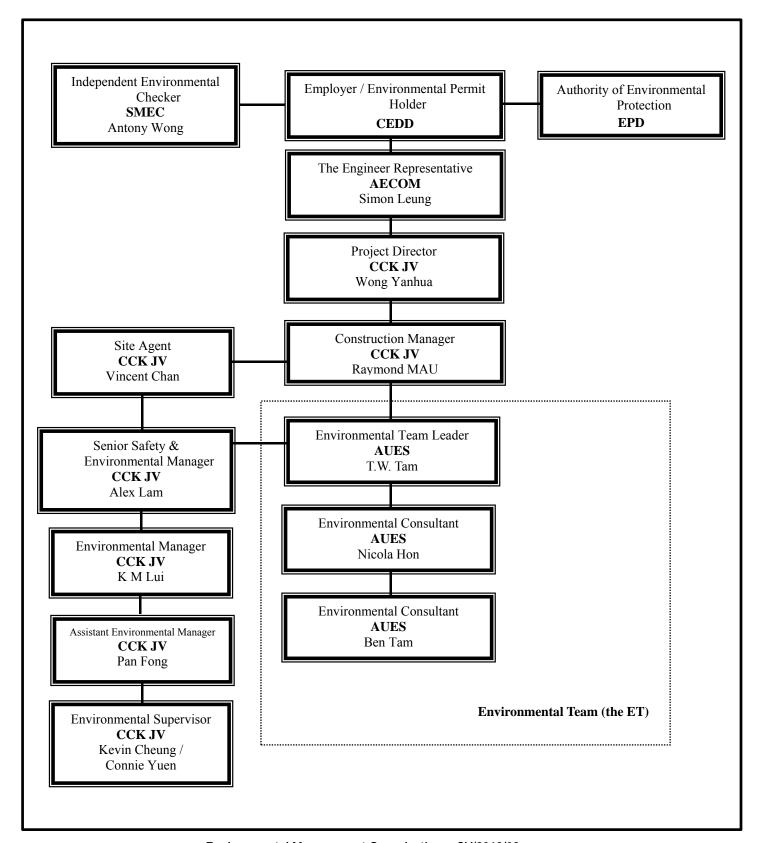

Environmental Management Organization – CV/2013/08



Contact Details of Key Personnel for Contract 6 - CV/2013/08

| Organization | Project Role | Name of Key Staff | Tel No. | Fax No. |
|--------------|--|------------------------------|------------------------|-----------|
| AECOM | Engineer's Representative | Simon Leung | 2674 2273 | 2674 7732 |
| SMEC | Independent Environmental Checker | Antony Wong | 3995 8120 | 3995 8101 |
| CCK JV | Project Director | Wang Yanhua | 6190 4212 | |
| CCK JV | Construction Manager | Raymond Mau Sai-Wai | 9011 5340 | |
| ССК ЈУ | Site Agent | Vincent Chan | 9655 9404 | |
| CCK JV | Senior Safety & Environmental Manager | Alex Lam | 5547 0181 | |
| CCK JV | Environmental Manager | K M Lui | 51138223 | |
| ССК ЈУ | Assistant Environmental Officer | Pan Fong | 9436 9432 | |
| CCK JV | Environmental Supervisor | Kevin Cheung/ Connie Yuen | 6316 6931 6117 1344 | |
| AUES | Environmental Team Leader | TW Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Ben Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Nicola Hon | 2959 6059 | 2959 6079 |

Legend:


CEDD (Employer) - Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

CCK JV (Main Contractor) – CRBE-CEC-Kaden Joint Venture

SMEC (IEC) – SMEC Asia Limited



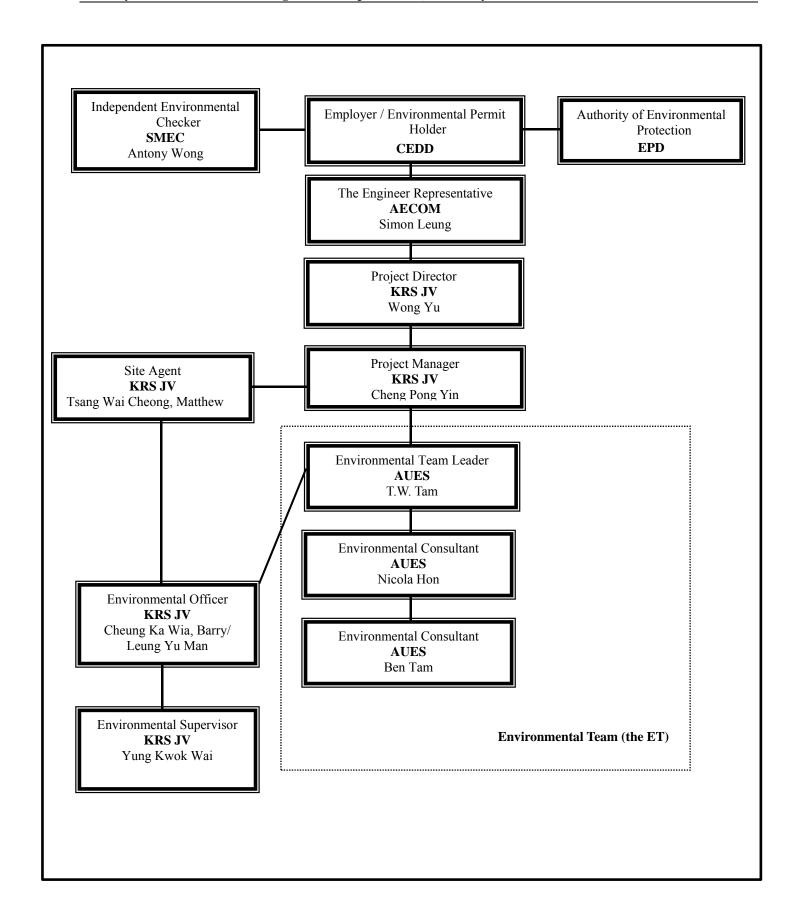

Environmental Management Organization -NE/2014/03



Contact Details of Key Personnel for Contract 7 – NE/2014/03

| Organization | Project Role | Name of Key Staff | Tel No. | Fax No. |
|--------------|--------------------------------------|------------------------------|-----------|-----------|
| AECOM | Engineer's Representative | Simon Leung | 2674 2273 | 2674 7732 |
| SMEC | Independent Environmental Checker | Antony Wong | 3995 8120 | 3995 8101 |
| KRSJV | Project Director | Wong Yu | 2682 6691 | 2682 2783 |
| KRSJV | Project Manager | Cheng Pong Yin | 9023 4821 | 2682 2783 |
| KRSJV | Site Agent | Tsang Wai Cheong, Matthew | 9705 7536 | 2682 2783 |
| KRSJV | Environmental Officer | Cheung Ka Wia, Barry | 6117 2339 | 2682 2783 |
| KRSJV | Environmental Officer | Leung Yu Man | 6592 3084 | 2682 2783 |
| KRSJV | Environmental Supervisor | Yung Kwok Wai | 6592 3084 | 2682 2783 |
| AUES | Environmental Team Leader | TW Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Ben Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Nicola Hon | 2959 6059 | 2959 6079 |

Legend:


CEDD (Employer) - Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

KRS JV (Main Contractor) –Kwan On-Richwell-SCG Joint Venture

SMEC (IEC) – SMEC Asia Limited



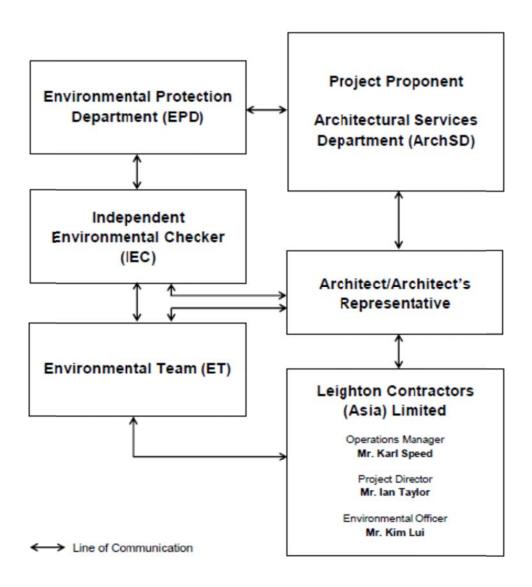

Environmental Management Organigram

Environmental Management Organization for Contract SS C505



Contact Details of Key Personnel for Contract SS C505

| Organization | Project Role | Name of Key Staff | Tel No. | Fax No. |
|-------------------------|--|-------------------|-----------|-----------|
| ArchSD | Works agent for the Development Bureau (DEVB) | Mr. William Cheng | 2867 3904 | 2804 6805 |
| Ronald Lu & Partners | Architect/ Architect's Representative | Mr. Justin Cheung | 3189 9272 | 2834 5442 |
| SMEC | Independent Environmental Checker | Mr. Antony Wong | 3995 8120 | 3995 8101 |
| Leighton | Operation Manager | Mr. Karl Speed | 2823 1433 | 25298784 |
| Leighton | Project Director | Mr. Ian Taylor | 2858 1519 | 2858 1899 |
| Leighton | Environmental Officer | Mr. Kim Lui | 3973 1069 | - |
| Leighton | Assistant Environmental Officer | Ms. Penny Yiu | 3973 0818 | - |
| AUES | Environmental Team Leader | Mr. T. W. Tam | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Ms. Nicola Hon | 2959 6059 | 2959 6079 |
| AUES | Environmental Consultant | Mr. Ben Tam | 2959 6059 | 2959 6079 |

Legend:

ArchSD (Project Proponent) – Architectural Services Department

Ronald Lu & Partners (Architect/ Architect's Representative) -Ronald Lu & Partners (Hong Kong) Ltd

Leighton (Main Contractor) – Leighton Contractors (Asia) Limited

SMEC (IEC) – SMEC Asia Limited



Appendix C

3-month rolling construction program



Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2012/08

Main Contractor: Dragages Hong Kong Ltd



Tentative Three Months (January, February and March 2017) Construction Rolling Progam


| Item | Major Construction Activites |
|------|---|
| 1 | Admin Bldg - Construction of permanent drainage, fencing wall, internal fitting out and curtain wall installation |
| | Mid Vent Portal - Adit invert slab, waterproofing and lining |
| 4 | Mid Vent Portal - Perparation for TBM South drive break out |
| 5 | Mid Vent Portal - Connecting structure and ventilation building superstructure works |
| 7 | North Portal - Southbound tunnel excavation by TBM |
| | North Portal - Construction of cross passage and internal structure |
| 10 | North Portal - Retaining walls and slope stabilizations |
| | North Portal - North ventilation building superstructure |
| 12 | South Portal - Northbound and Southbound tunnel D&B excavation |
| 13 | South Portal - South ventilation building superstructure works |
| 14 | South Portal - Tunnel invert, waterproofing and lining |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |



Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2012/09

Main Contractor: Chun Wo Construction Ltd



Tentative Three Months (January, February and March 2017) Construction Rolling Progam

| Item | Construction Activites |
|------|--|
| 1 | Boundary Wall for Pumping Station |
| 2 | Abutment Construction |
| 3 | Cable Detection and Trial Trenches |
| 4 | Construction of Remaining Slab of Box Culvert ID04 |
| 5 | Demolition of Existing Kiu Tau Vehicular Bridge |
| 6 | Extended Podium Construction |
| 7 | Gabion Wall Construction |
| 8 | Installation of Noise Barrier Steel Column and Panel |
| 9 | Re-provisioning of the Existing Kiu Tau Footbridge |
| 10 | Storm Drains Laying |
| 11 | Installation Works of Mini-pile |
| 12 | Noise Barrier Construction |
| 13 | Pier / Pier Table Construction |
| 14 | Pipe Jacking works for DN2200 Water Mains |
| 15 | Portal Construction |
| 16 | Profile Barrier Construction on Viaduct |
| 17 | Retaining Wall Construction |
| 18 | Road Works |
| 19 | Roundabout Modification Works |
| 20 | Sewer Works |
| 21 | Slope Reinstatement Works near bridge E |
| 22 | Utilities Duct Laying |
| 23 | Viaduct Segment Erection |
| 24 | Water Main Laying |
| | |
| | |
| | |
| | |
| | |



Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2013/08

Main Contractor: CRBE-CEC-Kaden Joint Venture



Tentative Three Months (January, February and March 2017) Construction Rolling Progam

| Item | Construction Activites |
|------|-------------------------------------|
| | |
| | Bored Piling |
| 2 | Pile Cap Construction |
| 3 | Bridge Pier Constrcution |
| 4 | Segment Erection |
| 5 | Tunnel Works |
| 6 | Sewage Treatment Plant Construction |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |



Contract 7

Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: NE/2014/03

Main Contractor: Kwan On-Richwell-SCG Joint Venture



Tentative Three Months(January 2017, February 2017 and March 2017) Construction Rolling Progam

| Item | Construction Activites |
|------|---|
| 1 | Bridge A - U-trough |
| 2 | Bridge A - Pile Caps and Column |
| 3 | Bridge B - Column and Deck |
| 4 | Bridge C - Construction of 2nd and 3rd Floor Slab |
| 5 | Bridge D - Column and Deck |
| 6 | Bridge E - U-trough |
| 7 | Bridge E - Pile Caps and Column |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |



Contract SS C505

Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

ArchSD Contract No: SSC505
Main Contractor: Leighton




Tentative Three Months (January, February and March 2017) Construction Rolling Progam


| Item | Construction Activites |
|------|---|
| 1 | Passenger Terminal Building - Substructure Works |
| 2 | Passenger Terminal Building - RC Superstructure Works |
| | Passenger Terminal Building - ABWF Works & Building Services Installation Works |
| 4 | C&ED Detector Dog Base - Substructure, RC structures and Integrated ABWF & BS Works |
| 5 | HKPF Building and Observation Tower - Substructure, RC structures, Integrated ABWF and BS Works |
| 6 | Fire Station and Drill Tower - Substructures, RC structures, Integradted ABWF and MEP Works |
| 7 | Cargo Examination Building (Inbound) - Underground Drainage & Utilities, RC Structure and Integrated ABWF & BS Works |
| 8 | Cargo Examination Building (Outbound) - Underground Drainage & Utilities and RC Structure, ABWF & BS Works |
| 9 | Fixed X-ray Vehicle Inspection System (FXRVIS) Buildings (Inbound) - Substructures, RC Structures and ABWF & MEP |
| 10 | Fixed X-ray Vehicle Inspection System (FXRVIS) Buildings (Outbound) - Substructures, RC Structural Works and ABWF & MEP |
| 11 | GV Kiosk (Inbound) - Earthworks and Substructures |
| 12 | GV Kiosk (Outbound) - Earthworks and Substructures |
| | Public Toilets (Inbound) - Earthworks and Substructures |
| 14 | Public Toilets (Outbound) - Earthworks and Substructures |
| 15 | MXRVSS (Inbound) - Site Formation works |
| 16 | MXRVSS (Outbound) - Structures works |
| | Fire Hydrant Tank & Pump Room - Structural Works, ABWF & BS works and Contractors Testing |
| 18 | Elevated Walkway - Structure Works |
| 19 | Vehicular bridges - Pilecaps / Piers / abutment / retaining walls / portal, Bridge Decks |
| 20 | External Works in Portion 1 - Underground utilities, Road Works and Landscaping |
| 21 | External Works in Portion 2 - Underground utilities, Road Works and Landscaping |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |




Appendix D

Designated Monitoring Locations as Recommended in the Approved EM&A Manual

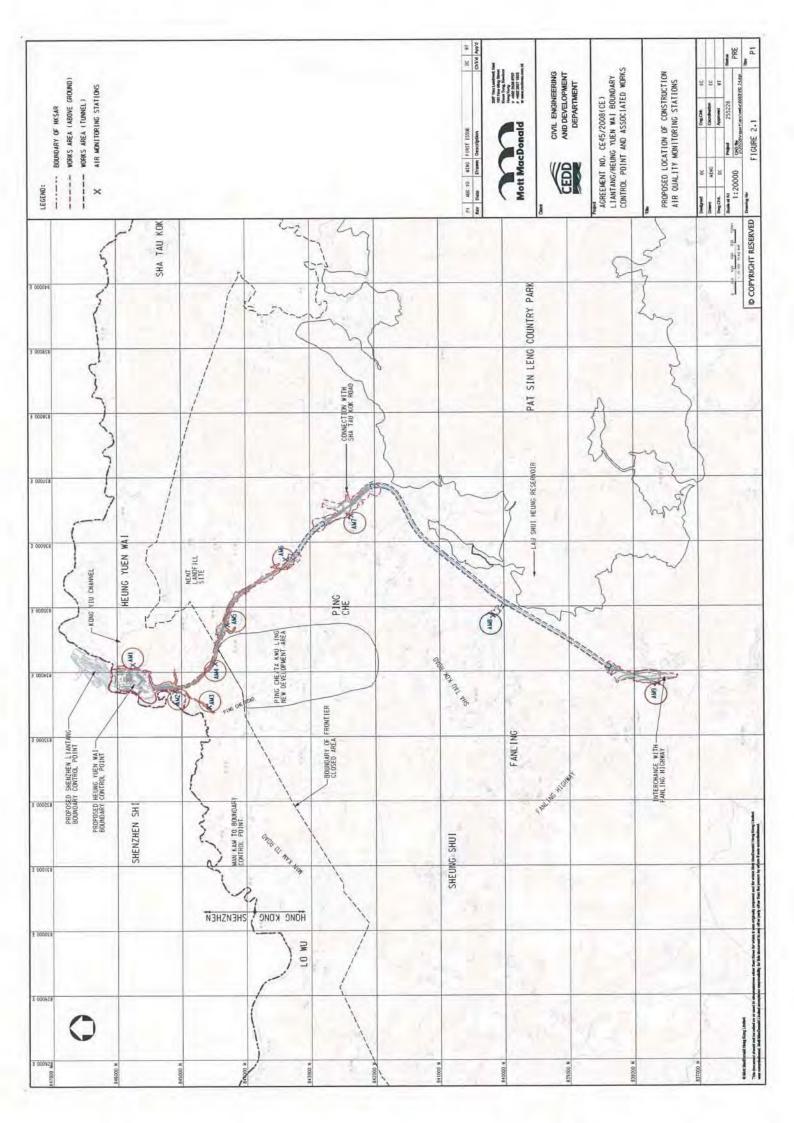

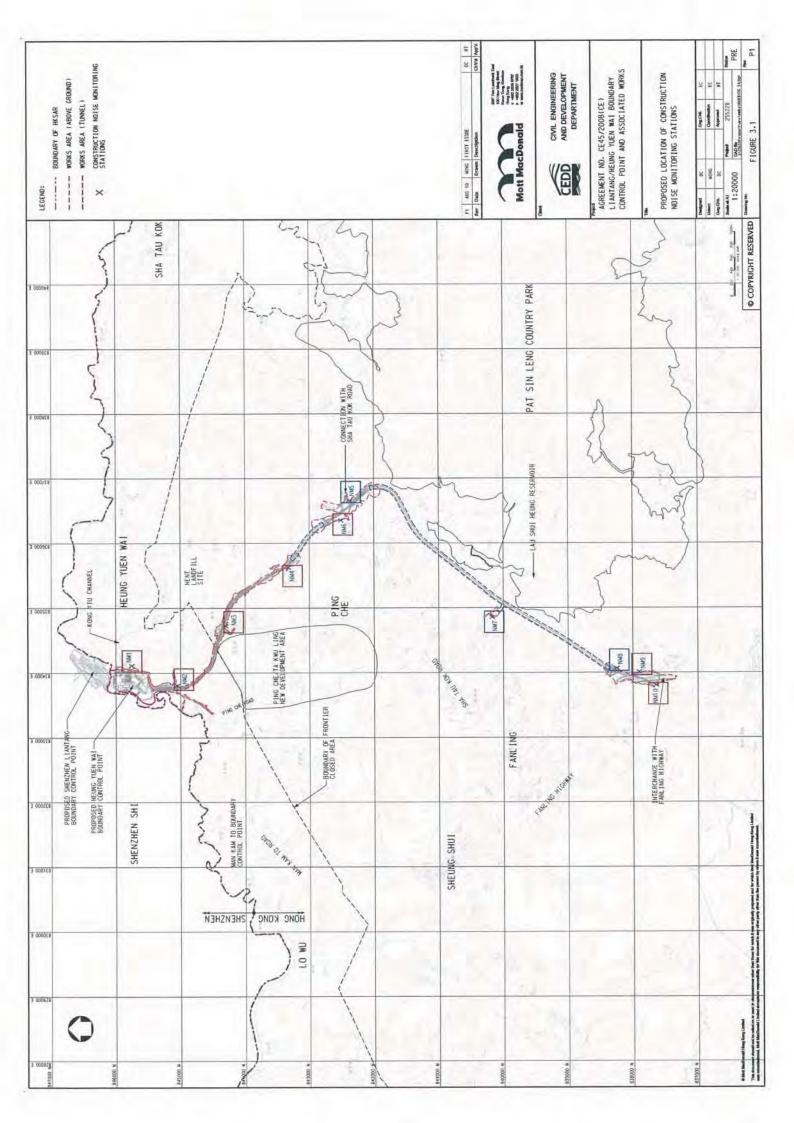


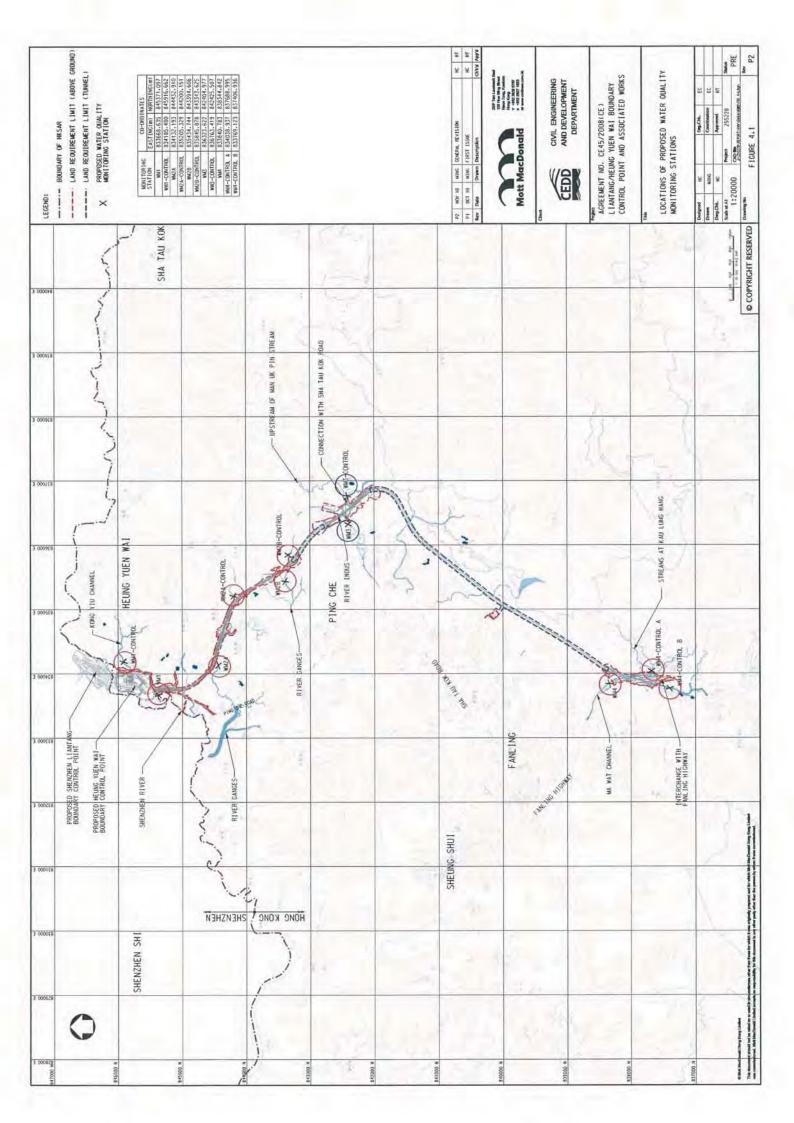





Appendix E

Monitoring Locations for Impact Monitoring

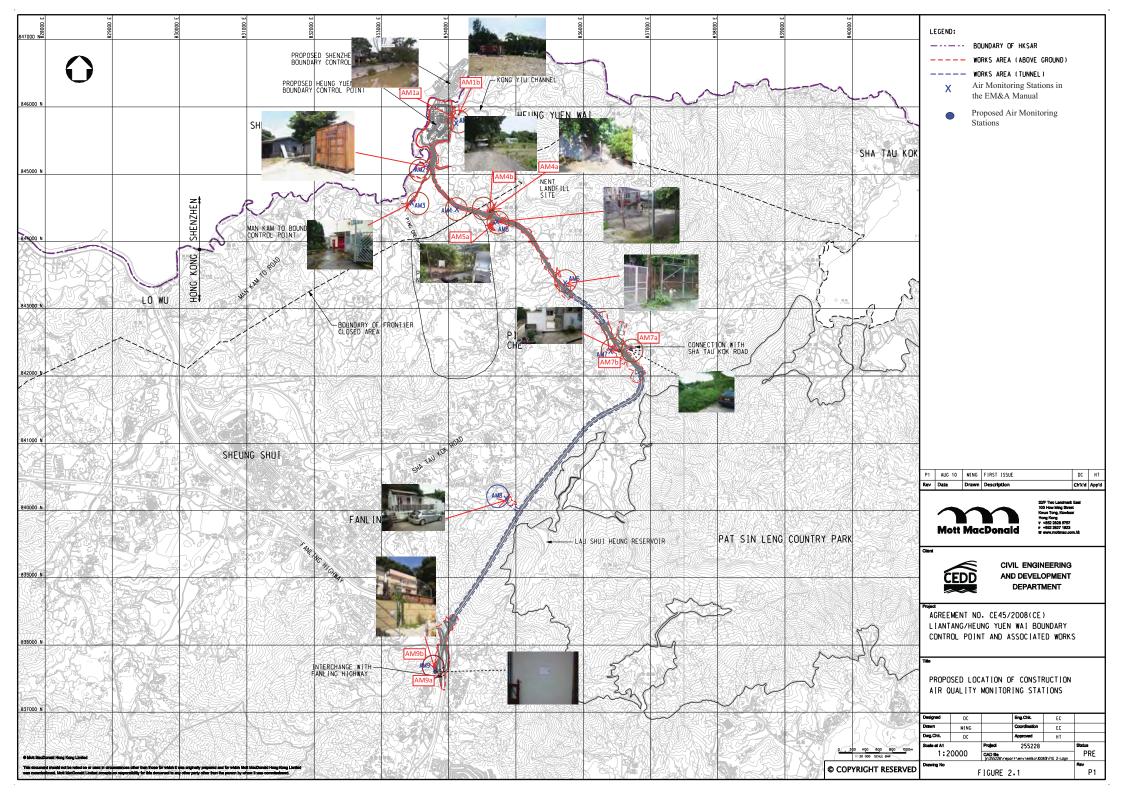

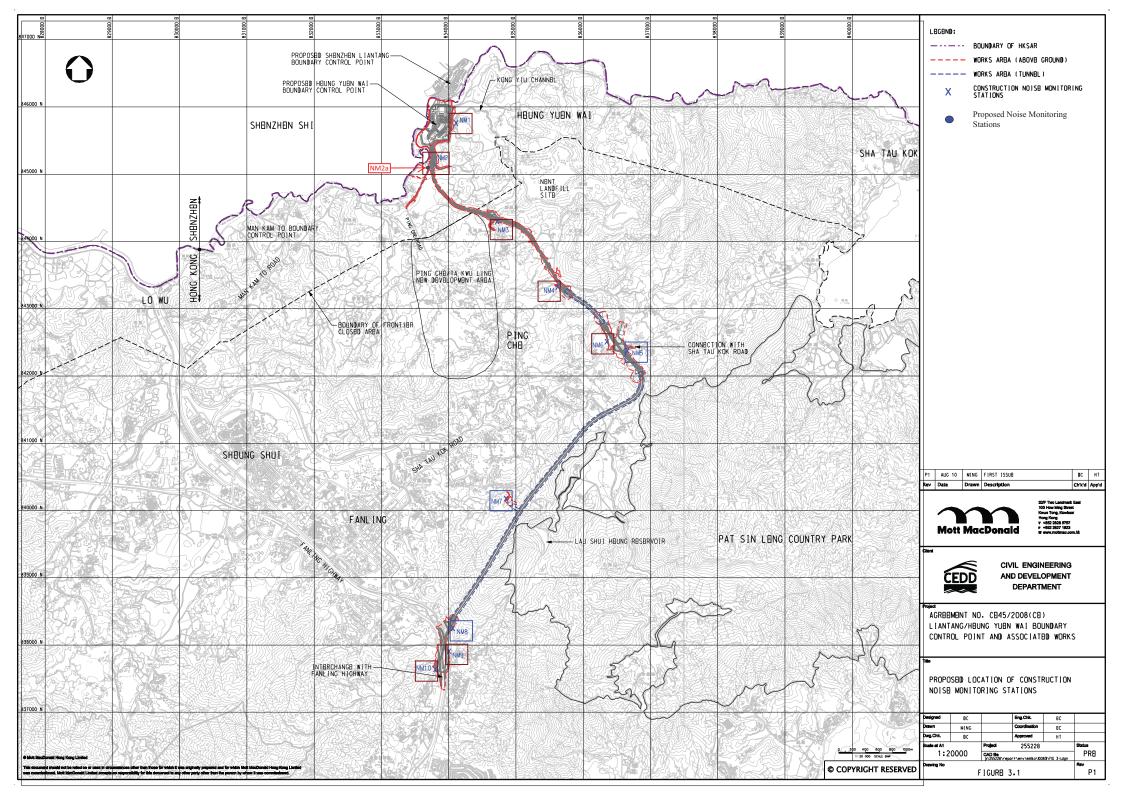

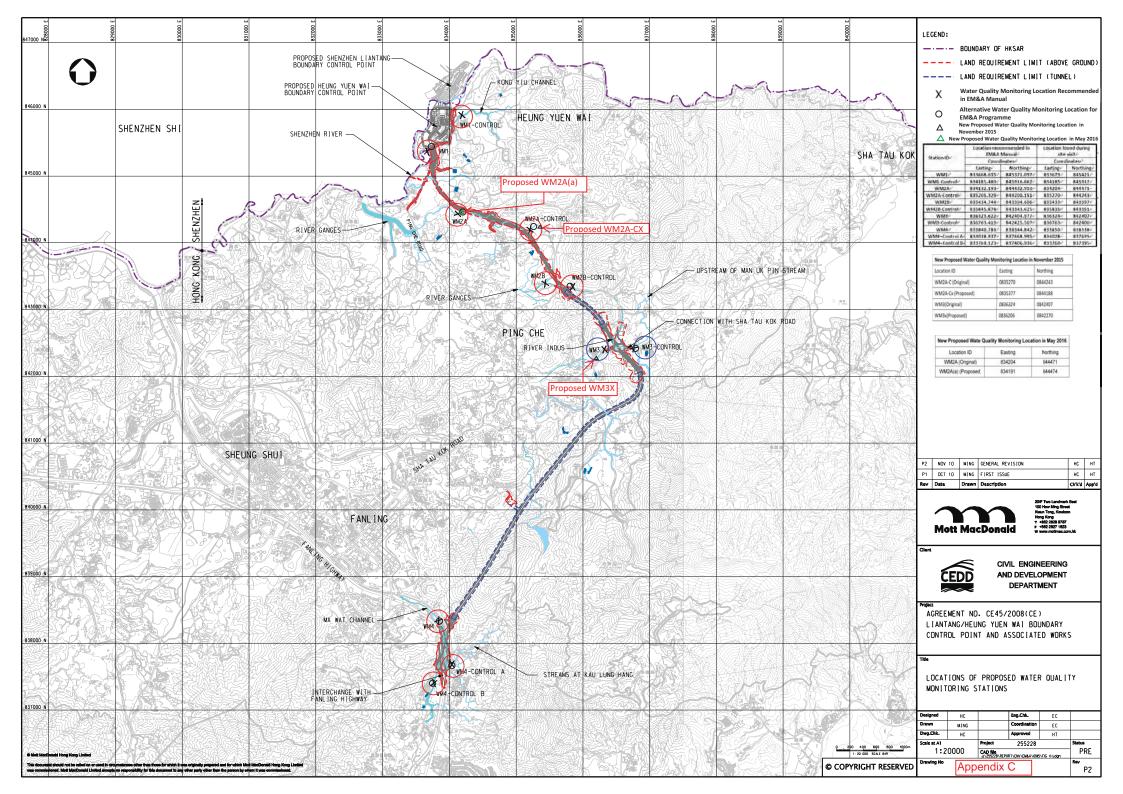



Appendix F

Calibration Certificate of Monitoring Equipment and HOKLAS-accreditation Certificate of the Testing Laboratory

Location: Open area at Tsung Yuen Ha Village

Date of Calibration: 24/12/2016

Location ID: AM1b

Next Calibration Date: 24/2/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1019.2 18.1

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | Ι | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.784 | 50 | 50.74 | Slope = 25.3669 |
| 13 | 4.9 | 4.9 | 9.8 | 1.600 | 47 | 47.69 | Intercept = 6.5971 |
| 10 | 3.6 | 3.6 | 7.2 | 1.374 | 42 | 42.62 | Corr. coeff. = 0.9944 |
| 7 | 2.6 | 2.6 | 5.2 | 1.170 | 36 | 36.53 | |
| 5 | 1.5 | 1.5 | 3.0 | 0.892 | 28 | 28.41 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

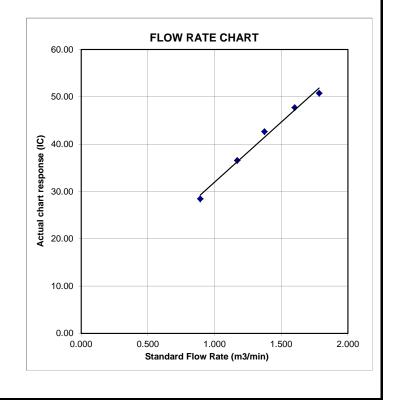

Location: Village House near Lin Ma Hang Road Date of Calibration: 24/12/2016

Location ID: AM2 Next Calibration Date: 24/2/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1019.2 18.1

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6 | 6 | 12.0 | 1.769 | 54 | 54.79 | Slope = 32.4736 |
| 13 | 4.7 | 4.7 | 9.4 | 1.568 | 49 | 49.72 | Intercept = -2.0693 |
| 10 | 3.7 | 3.7 | 7.4 | 1.393 | 42 | 42.62 | Corr. coeff. = 0.9978 |
| 7 | 2.3 | 2.3 | 4.6 | 1.101 | 34 | 34.50 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.862 | 25 | 25.37 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

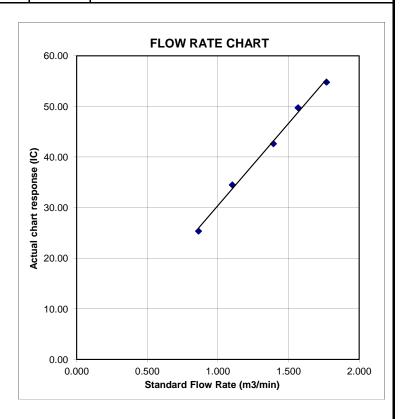

Location: Ta Kwu Ling Fire Service Station

Date of Calibration: 24/12/2016

Location ID: AM3

Next Calibration Date: 24/2/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) 1019.2 Corrected Pressure (mm Hg)
Temperature (°C) 18.1 Temperature (K)

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

764.4

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 5.5 | 5.5 | 11.0 | 1.695 | 57 | 57.84 | Slope = 29.4892 |
| 13 | 4.8 | 4.8 | 9.6 | 1.584 | 52 | 52.76 | Intercept = 6.3998 |
| 10 | 3.6 | 3.6 | 7.2 | 1.374 | 45 | 45.66 | Corr. coeff. = 0.9925 |
| 7 | 2.7 | 2.7 | 5.4 | 1.192 | 40 | 40.59 | |
| 5 | 1.3 | 1.4 | 2.7 | 0.847 | 32 | 32.47 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

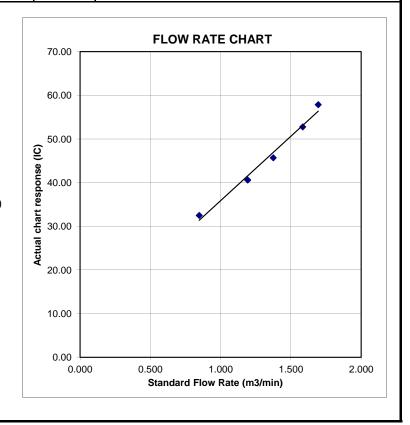

Location: Nga Yiu Ha VillageDate of Calibration:24/12/2016Location ID: AM4bNext Calibration Date:24/2/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1019.2

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 5.5 | 5.5 | 11.0 | 1.695 | 58 | 58.85 | Slope = 37.2438 |
| 13 | 4.5 | 4.5 | 9.0 | 1.534 | 51 | 51.75 | Intercept = -4.5869 |
| 10 | 3.4 | 3.4 | 6.8 | 1.336 | 45 | 45.66 | Corr. coeff. = 0.9992 |
| 7 | 2.3 | 2.3 | 4.6 | 1.101 | 36 | 36.53 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.862 | 27 | 27.40 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

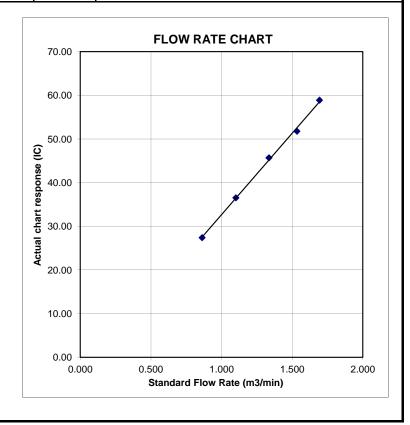

Location : Ping Yeung Village HouseDate of Calibration:24/12/2016Location ID : AM5aNext Calibration Date:24/2/2017

Technician:

Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1019.2 18.1

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.784 | 55 | 55.81 | Slope = 32.3303 |
| 13 | 4.8 | 4.8 | 9.6 | 1.584 | 48 | 48.71 | Intercept = -1.8749 |
| 10 | 3.7 | 3.7 | 7.4 | 1.393 | 43 | 43.63 | Corr. coeff. = 0.9986 |
| 7 | 2.3 | 2.3 | 4.6 | 1.101 | 34 | 34.50 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.862 | 25 | 25.37 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

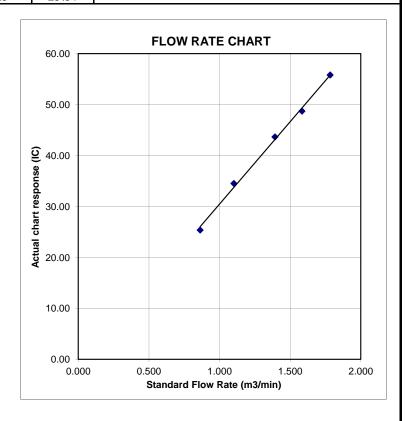

Location: Wo Keng Shan Village House Date of Calibration: 24/12/2016
Location ID: AM6 Next Calibration Date: 24/2/2017
Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1019.2

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.784 | 58 | 58.85 | Slope = 34.2523 |
| 13 | 5 | 5 | 10.0 | 1.616 | 51 | 51.75 | Intercept = -3.3101 |
| 10 | 3.9 | 3.9 | 7.8 | 1.429 | 44 | 44.65 | Corr. coeff. = 0.9965 |
| 7 | 2.3 | 2.3 | 4.6 | 1.101 | 33 | 33.49 | |
| 5 | 1.5 | 1.5 | 3.0 | 0.892 | 28 | 28.41 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

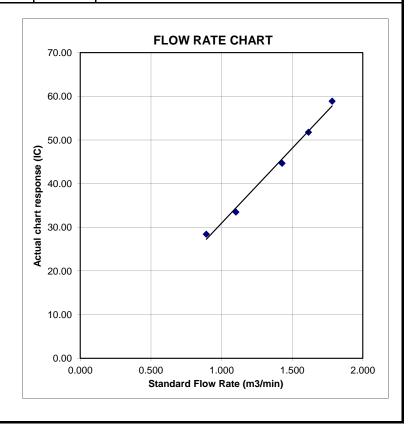

Location: Village House of Loi Tung Village

Date of Calibration: 24/12/2016

Location ID: AM7b

Next Calibration Date: 24/2/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1019.2 18.1

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 4.4 | 4.4 | 8.8 | 1.517 | 58 | 58.85 | Slope = 32.9385 |
| 13 | 3.5 | 3.5 | 7.0 | 1.355 | 53 | 53.78 | Intercept = 9.0367 |
| 10 | 2.7 | 2.7 | 5.4 | 1.192 | 48 | 48.71 | Corr. coeff. = 0.9992 |
| 7 | 1.8 | 1.8 | 3.6 | 0.976 | 40 | 40.59 | |
| 5 | 1.1 | 1.1 | 2.2 | 0.766 | 34 | 34.50 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

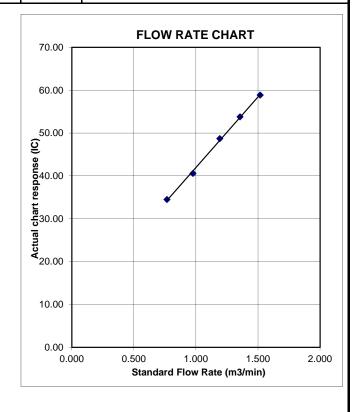

Location: Po Kat Tsai Village No. 4

Date of Calibration: 24/12/2016

Location ID: AM8

Next Calibration Date: 24/2/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1019.2 18.1

Corrected Pressure (mm Hg)
Temperature (K)

764.4 291

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

2.00411

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 5.6 | 5.6 | 11.2 | 1.710 | 63 | 63.93 | Slope = 34.2289 |
| 13 | 4.4 | 4.4 | 8.8 | 1.517 | 58 | 58.85 | Intercept = 6.0270 |
| 10 | 3.4 | 3.4 | 6.8 | 1.336 | 51 | 51.75 | Corr. coeff. = 0.9989 |
| 7 | 2.2 | 2.2 | 4.4 | 1.077 | 42 | 42.62 | |
| 5 | 1.3 | 1.3 | 2.6 | 0.832 | 34 | 34.50 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

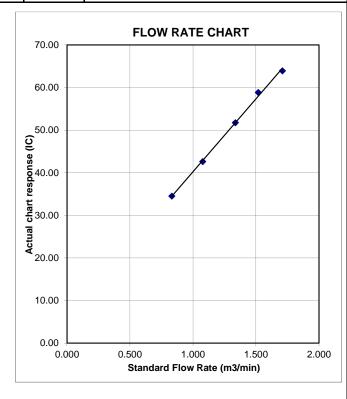

Location: Nam Wa Po Village House No. 80

Date of Calibration: 24/12/2016

Location ID: AM9b

Next Calibration Date: 24/2/2017

Technician: Fai So

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

| 1019.2 |
|--------|
| 18.1 |

Corrected Pressure (mm Hg)
Temperature (K)

| 764.4 |
|-------|
| 291 |
| |

CALIBRATION ORIFICE

| Make-> | TISCH |
|-------------|-------|
| Model-> | 5025A |
| Serial # -> | 1612 |

Qstd Slope -> Qstd Intercept -> 2.00411 -0.03059

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6 | 6.0 | 12.0 | 1.769 | 53 | 53.78 | Slope = 34.4503 |
| 13 | 4.8 | 4.8 | 9.6 | 1.584 | 47 | 47.69 | Intercept = -6.8178 |
| 10 | 3.7 | 3.7 | 7.4 | 1.393 | 41 | 41.60 | Corr. coeff. = 0.9992 |
| 7 | 2.4 | 2.4 | 4.8 | 1.125 | 32 | 32.47 | |
| 5 | 1.5 | 1.5 | 3.0 | 0.892 | 23 | 23.34 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

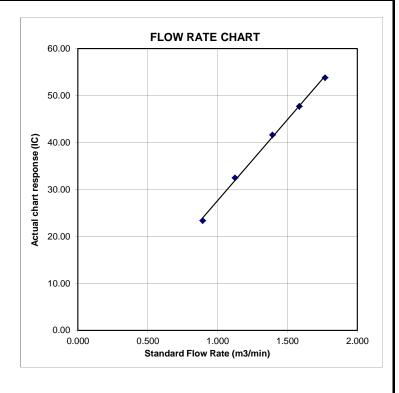



TISCH ENVIRONMENTAL, INC. 145 SOUTH MIAMI AVE VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

| | | | | AMBERRAGE | METER | ORFICE |
|----------------------|-------------------------|------------------------|------------------------|-----------------------|--------------------|----------------------|
| PLATE OR Run # | VOLUME START (m3) | VOLUME STOP (m3) | DIFF VOLUME (m3) | DIFF TIME (min) | DIFF Hg (mm) | DIFF H2O (in.) |
| 1 | NA NA | NA | 1.00 | 1.3770 | 2.2 | |
| 2 | NA | NA NA | 1.00 | 0.9710 | 3.2 6.4 | 2.0 |
| 3 | NA | NA | 1.00 | 0.8710 | 7.8 | 4.0 |
| 4 | NA | NA | 1.00 | 0.8310 | 8.7 | 5.5 |
| 5 | NA | NA | 1.00 | 0.6860 | 12.6 | 8.0 |

DATA TABULATION

| (x axis) Qa | (y axis) |
|--|--|
| 0.7231 1.0210 1.1360 1.1893 1.4330 | 0.8896 1.2581 1.4066 1.4753 1.7792 |
| pe (m) = pt (b) = ient (r) = | 1.25494 -0.01933 0.99995 |
| | |

CALCULATIONS

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta)

Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]

Qa = Va/Time

For subsequent flow rate calculations:

Qstd = $1/m\{[SQRT(H2O(Pa/760)(298/Ta))] - b\}$ $Qa = 1/m\{[SQRT H2O(Ta/Pa)] - b\}$

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 2X6145

Equipment Ref: EQ105

Job Order HK1603558

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 2 January 2016

Equipment Verification Results:

Testing Date: 4 to 6 January 2016

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|--|---------------------------------------|--|
| 2hr17min | 17:30 ~ 19:47 | 20.6 | 1018.9 | 0.027 | 1602 | 11.7 |
| 2hr42min | 17:00 ~ 19:42 | 20.7 | 1015.9 | 0.021 | 1522 | 9.3 |
| 2hr21min | 18:00 ~ 20:21 | 20.9 | 1018.8 | 0.051 | 3347 | 23.6 |

Sensitivity Adjustment Scale Setting (Before Calibration) 593

Sensitivity Adjustment Scale Setting (After Calibration) 596

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9985


Date of Issue 11 January 2016

Remarks:

1. Strong Correlation (R>0.8)

2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

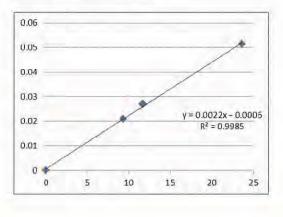

(CPM)

(CPM)

QC Reviewer : Ben Tam Signature : Date : 12 January 2016

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 2-Jan-16
Location ID: Calibration Room Next Calibration Date: 2-Apr-16

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1022 18.9

Corrected Pressure (mm Hg)
Temperature (K)

766.5 292

CALIBRATION ORIFICE

| Make-> | TISCH |
|--------------------|-----------|
| | |
| | 5025A |
| Calibration Date-> | 24-Mar-15 |

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10265 -0.00335 24-Mar-16

CALIBRATION

| - 1 | | | | | | | | |
|-----|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| | Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
| | No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| | 18 | 4.1 | 4.1 | 8.2 | 1.384 | 56 | 56.82 | Slope = 30.1332 |
| | 13 | 3.2 | 3.2 | 6.4 | 1.222 | 52 | 52.76 | Intercept = 15.8637 |
| | 10 | 2.4 | 2.4 | 4.8 | 1.059 | 48 | 48.71 | Corr. coeff. = 0.9950 |
| | 8 | 1.6 | 1.6 | 3.2 | 0.865 | 42 | 42.62 | |
| | 5 | 1.0 | 1.0 | 2.0 | 0.684 | 35 | 35.51 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

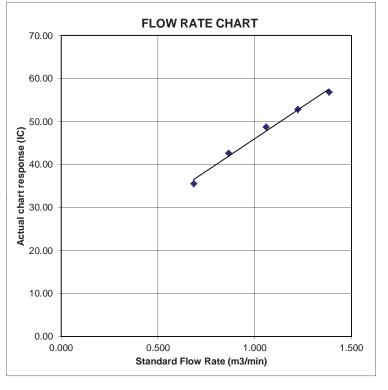

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 366409

Equipment Ref: EQ109

Job Order HK1603560

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 2 January 2016

Equipment Verification Results:

Testing Date: 4 to 6 January 2016

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|--|---------------------------------------|--|
| 2hr17min | 17:30 ~ 19:47 | 20.6 | 1018.9 | 0.027 | 1577 | 11.5 |
| 2hr42min | 17:00 ~ 19:42 | 20.7 | 1015.9 | 0.021 | 1433 | 8.8 |
| 2hr21min | 18:00 ~ 20:21 | 20.9 | 1018.8 | 0.051 | 3328 | 23.5 |

Sensitivity Adjustment Scale Setting (Before Calibration) 540 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 540 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9975


Date of Issue 11 January 2016

Remarks:

1. Strong Correlation (R>0.8)

2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

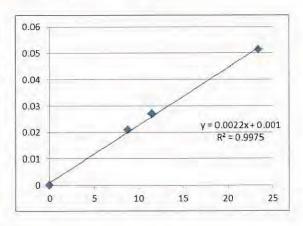

Operator: _____ Donald Kwok ____ Signature: _____ Date: ____ 12 January 2016

QC Reviewer : _____ Ben Tam ___ Signature : _____ Date : ____ 12 January 2016

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 2-Jan-16
Location ID: Calibration Room Next Calibration Date: 2-Apr-16

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1022 18.9

Corrected Pressure (mm Hg)
Temperature (K)

766.5 292

CALIBRATION ORIFICE

| Make-> | TISCH |
|--------------------|-----------|
| | |
| | 5025A |
| Calibration Date-> | 24-Mar-15 |

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10265 -0.00335 24-Mar-16

CALIBRATION

| - 1 | | | | | | | | |
|-----|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| | Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
| | No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| | 18 | 4.1 | 4.1 | 8.2 | 1.384 | 56 | 56.82 | Slope = 30.1332 |
| | 13 | 3.2 | 3.2 | 6.4 | 1.222 | 52 | 52.76 | Intercept = 15.8637 |
| | 10 | 2.4 | 2.4 | 4.8 | 1.059 | 48 | 48.71 | Corr. coeff. = 0.9950 |
| | 8 | 1.6 | 1.6 | 3.2 | 0.865 | 42 | 42.62 | |
| | 5 | 1.0 | 1.0 | 2.0 | 0.684 | 35 | 35.51 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

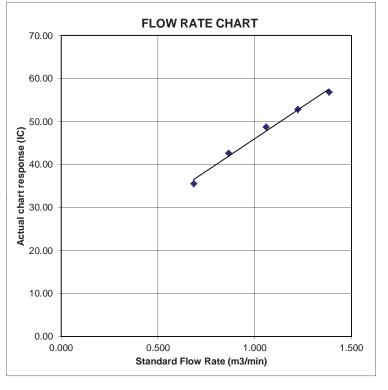

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 366410

Equipment Ref: EQ110

Job Order HK1603561

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 2 January 2016

Equipment Verification Results:

Testing Date: 4 to 6 January 2016

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|---|---------------------------------------|--|
| 2hr17min | 17:30 ~ 19:47 | 20.6 | 1018.9 | 0.027 | 1566 | 11.4 |
| 2hr42min | 17:00 ~ 19:42 | 20.7 | 1015.9 | 0.021 | 1422 | 8.7 |
| 2hr21min | 18:00 ~ 20:21 | 20.9 | 1018.8 | 0.051 | 3318 | 23.4 |

Sensitivity Adjustment Scale Setting (Before Calibration) 660 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 661 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9973

Date of Issue 11 January 2016

Remarks:

- 1. Strong Correlation (R>0.8)
- Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

| 0.05 | | | | / | - |
|------|---|---|-----|-----------------------|--------------|
| 0.04 | | | / | | _ |
| 0.03 | | * | | | |
| | | | | | |
| 0.02 | | * | y = | 0.0022x+ | 0.001 |
| 0.02 | / | * | у = | $R^2 = 0.99$ | 0,001 73 |
| | | * | у = | R ² = 0.99 | 0.0011 73 |
| 0.02 | | * | γ= | R ² = 0.99 | 0,001 |

Operator: Donald Kwok Signature: Date: 12 January 2016

QC Reviewer: Ben Tam Signature: Date: 12 January 2016

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 2-Jan-16
Location ID: Calibration Room Next Calibration Date: 2-Apr-16

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1022 18.9

Corrected Pressure (mm Hg)
Temperature (K)

766.5 292

CALIBRATION ORIFICE

| Make-> | TISCH |
|--------------------|-----------|
| | |
| | 5025A |
| Calibration Date-> | 24-Mar-15 |

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10265 -0.00335 24-Mar-16

CALIBRATION

| - 1 | | | | | | | | |
|-----|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| | Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
| | No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| | 18 | 4.1 | 4.1 | 8.2 | 1.384 | 56 | 56.82 | Slope = 30.1332 |
| | 13 | 3.2 | 3.2 | 6.4 | 1.222 | 52 | 52.76 | Intercept = 15.8637 |
| | 10 | 2.4 | 2.4 | 4.8 | 1.059 | 48 | 48.71 | Corr. coeff. = 0.9950 |
| | 8 | 1.6 | 1.6 | 3.2 | 0.865 | 42 | 42.62 | |
| | 5 | 1.0 | 1.0 | 2.0 | 0.684 | 35 | 35.51 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

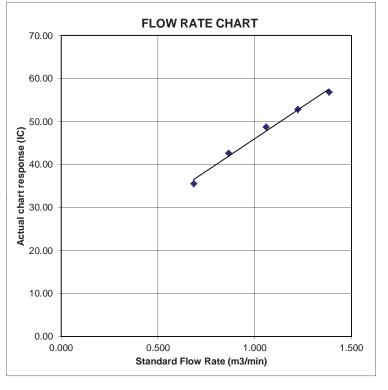

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 3Y6503

Equipment Ref: EQ112

Job Order HK1603553

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 2 January 2016

Equipment Verification Results:

Testing Date: 4 to 6 January 2016

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|--|---------------------------------------|--|
| 2hr17min | 17:30 ~ 19:47 | 20.6 | 1018.9 | 0.027 | 1633 | 11.9 |
| 2hr42min | 17:00 ~ 19:42 | 20.7 | 1015.9 | 0.021 | 1502 | 9.2 |
| 2hr21min | 18:00 ~ 20:21 | 20.9 | 1018.8 | 0.051 | 3365 | 23.8 |

Sensitivity Adjustment Scale Setting (Before Calibration)
Sensitivity Adjustment Scale Setting (After Calibration)

642 (CPM) 648 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022


Date of Issue 11 January 2016

Remarks:

1. Strong Correlation (R>0.8)

2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

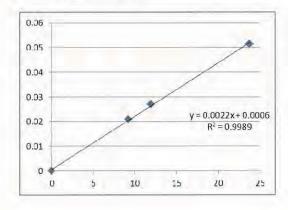

Operator: ______ Donald Kwok ____ Signature: ______ Date: ____ 12 January 2016

QC Reviewer: Ben Tam Signature: Date: 12 January 2016

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 2-Jan-16
Location ID: Calibration Room Next Calibration Date: 2-Apr-16

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1022 18.9

Corrected Pressure (mm Hg)
Temperature (K)

766.5 292

CALIBRATION ORIFICE

| Make-> | TISCH |
|--------------------|-----------|
| | |
| | 5025A |
| Calibration Date-> | 24-Mar-15 |

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10265 -0.00335 24-Mar-16

CALIBRATION

| - 1 | | | | | | | | |
|-----|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| | Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
| | No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| | 18 | 4.1 | 4.1 | 8.2 | 1.384 | 56 | 56.82 | Slope = 30.1332 |
| | 13 | 3.2 | 3.2 | 6.4 | 1.222 | 52 | 52.76 | Intercept = 15.8637 |
| | 10 | 2.4 | 2.4 | 4.8 | 1.059 | 48 | 48.71 | Corr. coeff. = 0.9950 |
| | 8 | 1.6 | 1.6 | 3.2 | 0.865 | 42 | 42.62 | |
| | 5 | 1.0 | 1.0 | 2.0 | 0.684 | 35 | 35.51 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

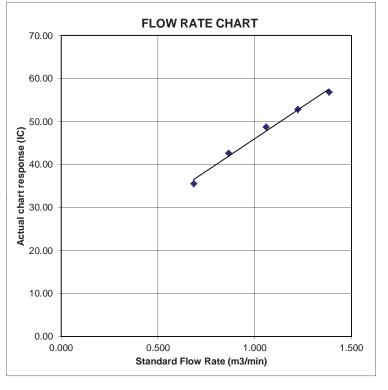

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 3Y6505

Equipment Ref: EQ114

Job Order HK1603562

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 2 January 2016

Equipment Verification Results:

Testing Date: 4 to 6 January 2016

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|--|---------------------------------------|--|
| 2hr17min | 17:30 ~ 19:47 | 20.6 | 1018.9 | 0.027 | 1589 | 11.6 |
| 2hr42min | 17:00 ~ 19:42 | 20.7 | 1015.9 | 0.021 | 1473 | 9.0 |
| 2hr21min | 18:00 ~ 20:21 | 20.9 | 1018.8 | 0.051 | 3314 | 23.4 |

Sensitivity Adjustment Scale Setting (Before Calibration) 59
Sensitivity Adjustment Scale Setting (After Calibration) 59

588 (CPM) 585 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9985

Date of Issue 11 January 2016

Remarks:

1. Strong Correlation (R>0.8)

2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

| 0.06 | | | | | |
|------|---|----|-----|-------------------------------------|-------------|
| 0.05 | | | | / | * |
| 0.04 | | | / | | _ |
| | | | / | | |
| 0.03 | | * | | | |
| | | * | y = | = 0.0022x+ | 0.000 |
| | - | ** | y = | = 0.0022x+ R ² = 0.99 | 0.000 85 |
| 0.02 | / | ** | y = | = 0.0022x+ R ² = 0.99 | 0.000° |
| 0.03 | | ** | y = | = 0.0022x+ R ² = 0.99 | 0.000° |

Operator: Donald Kwok Signature: Date: 12 January 2016

QC Reviewer: Ben Tam Signature: Date: 12 January 2016

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 2-Jan-16
Location ID: Calibration Room Next Calibration Date: 2-Apr-16

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1022 18.9

Corrected Pressure (mm Hg)
Temperature (K)

766.5 292

CALIBRATION ORIFICE

| Make-> | TISCH |
|--------------------|-----------|
| | |
| | 5025A |
| Calibration Date-> | 24-Mar-15 |

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10265 -0.00335 24-Mar-16

CALIBRATION

| - 1 | | | | | | | | |
|-----|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| | Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
| | No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| | 18 | 4.1 | 4.1 | 8.2 | 1.384 | 56 | 56.82 | Slope = 30.1332 |
| | 13 | 3.2 | 3.2 | 6.4 | 1.222 | 52 | 52.76 | Intercept = 15.8637 |
| | 10 | 2.4 | 2.4 | 4.8 | 1.059 | 48 | 48.71 | Corr. coeff. = 0.9950 |
| | 8 | 1.6 | 1.6 | 3.2 | 0.865 | 42 | 42.62 | |
| | 5 | 1.0 | 1.0 | 2.0 | 0.684 | 35 | 35.51 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

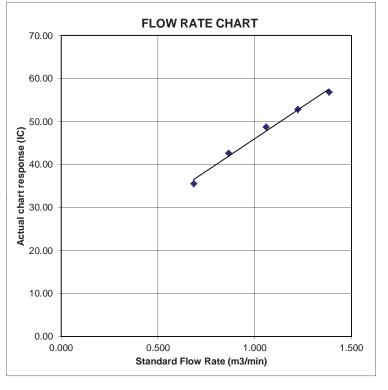

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 2X6145

Equipment Ref: EQ105

Job Order HK1703462

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m ³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|---|---------------------------------------|--|
| 3hr14min | 09:10 ~ 12:24 | 20.6 | 1016.3 | 0.145 | 13025 | 67.2 |
| 1hr57min | 12:30 ~ 14:27 | 20.6 | 1016.3 | 0.069 | 3586 | 30.6 |
| 1hr58min | 14:35 ~ 16:33 | 20.6 | 1016.3 | 0.091 | 4709 | 39.6 |

Sensitivity Adjustment Scale Setting (Before Calibration) 581 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 580 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9992

 Date of Issue
 11 January 2017

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

| 0.16 | | | - | |
|------|-----|-------|---------------------------------|-----|
| 0.14 | | | | |
| 0.12 | | | | |
| 0.1 | | | | |
| 80.0 | | 1 | | |
| 0.06 | | y = 0 | $0.0022x + 0.00$ $R^2 = 0.9985$ | 016 |
| 0.04 | -/- | | K* = 0.9985 | |
| 0.02 | / | | | |
| U | | | | - |
| | 20 | 40 | 60 | 80 |

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer: Ben Tam Signature: Date: 11 January 2017

Date of Calibration: 25-Nov-16 Location: Gold King Industrial Building, Kwai Chung Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa)

1016.4 Temperature (°C) 20.0 Corrected Pressure (mm Hg) Temperature (K)

762.3 293

CALIBRATION ORIFICE

Make-> TISCH Model-> 5025A

Calibration Date-> 14-Mar-16

Ostd Slope -> Qstd Intercept ->

Expiry Date->

2.00411 -0.03059 14-Mar-17

CALIBRATION

| Plate | H20 (L)H2O (R) | | H20 | Qstd | I | IC | LINEAR |
|-------|----------------|------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.776 | 56 | 56.56 | Slope = 35.6871 |
| 13 | 4.7 | 4.7 | 9.4 | 1.560 | 49 | 49.49 | Intercept = -6.1123 |
| 10 | 3.6 | 3.6 | 7.2 | 1.368 | 43 | 43.43 | Corr. coeff. = 0.9967 |
| 8 | 2.3 | 2.3 | 4.6 | 1.096 | 34 | 34.34 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.859 | 23 | 23.23 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Ostd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

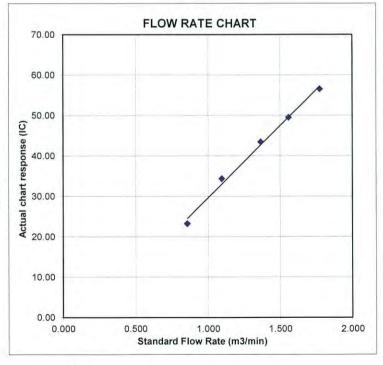

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. <u>366409</u>

Equipment Ref: EQ109

Job Order HK1703455

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) | |
|----------|---------------|-----------------|---------------------------|---|---------------------------------------|--|--|
| 3hr14min | 09:10 ~ 12:24 | 20.6 | 1016.3 | 0.145 | 12487 | 64.4 | |
| 1hr57min | 12:30 ~ 14:27 | 20.6 | 1016.3 | 0.069 | 3433 | 29.3 | |
| 1hr58min | 14:35 ~ 16:33 | 20.6 | 1016.3 | 0.091 | 4815 | 40.5 | |

Sensitivity Adjustment Scale Setting (Before Calibration) 523 (CPM)


Sensitivity Adjustment Scale Setting (After Calibration) 525 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9997

Date of Issue 11 January 2017

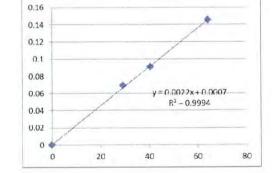

Remarks:

1. Strong Correlation (R>0.8)

2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer: Ben Tam Signature: Date: 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16
Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa) 1016.4 Corrected Pressure (mm Hg) 762.3 Temperature (°C) 20.0 Temperature (K) 293

CALIBRATION ORIFICE

Make-> TISCH Qstd Slope -> 2.00411
Model-> 5025A Qstd Intercept -> -0.03059
Calibration Date-> 14-Mar-16 Expiry Date-> 14-Mar-17

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.776 | 56 | 56.56 | Slope = 35.6871 |
| 13 | 4.7 | 4.7 | 9.4 | 1.560 | 49 | 49.49 | Intercept = -6.1123 |
| 10 | 3.6 | 3.6 | 7.2 | 1.368 | 43 | 43.43 | Corr. coeff. = 0.9967 |
| 8 | 2.3 | 2.3 | 4.6 | 1.096 | 34 | 34.34 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.859 | 23 | 23.23 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

Pav = daily average pressure

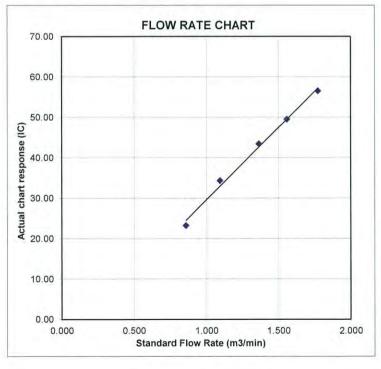

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 366410

Equipment Ref: EQ110

Job Order HK1703460

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) | |
|----------|---------------|-----------------|---------------------------|---|---------------------------------------|--|--|
| 3hr14min | 09:10 ~ 12:24 | 20.6 | 1016.3 | 0.145 | 12401 | 64.0 | |
| 1hr57min | 12:30 ~ 14:27 | 20.6 | 1016.3 | 0.069 | 3266 | 27.9 | |
| 1hr58min | 14:35 ~ 16:33 | 20.6 | 1016.3 | 0.091 | 4878 | 41.1 | |

Sensitivity Adjustment Scale Setting (Before Calibration) 677 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 675 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9984

 Date of Issue
 11 January 2017

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

| 0.16 | | | | |
|------|-----|----|-------------|---|
| 0.14 | | | | |
| 0.12 | | | / | |
| 0.1 | | _/ | | _ |
| 80.0 | | | | |
| 0.06 | ~ | | 0022x+0.001 | 5 |
| | / | R | 2 - 0.9969 | |
| | -/- | | | |
| 0.04 | | | | |
| 0.04 | | | | |

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer : _____ Ben Tam ___ Signature : _____ Date : ____ 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16

Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa) 1016.4 Corrected Pressure (mm Hg) 762.3
Temperature (°C) 20.0 Temperature (K) 293

CALIBRATION ORIFICE

 Make->
 TISCH
 Qstd Slope ->
 2.00411

 Model->
 5025A
 Qstd Intercept ->
 -0.03059

 Calibration Date->
 14-Mar-16
 Expiry Date->
 14-Mar-17

CALIBRATION

| Plate | | H2O (R) | H20 | Qstd | I | IC . | LINEAR |
|-------|------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.776 | 56 | 56.56 | Slope = 35.6871 |
| 13 | 4.7 | 4.7 | 9.4 | 1.560 | 49 | 49.49 | Intercept = -6.1123 |
| 10 | 3.6 | 3.6 | 7.2 | 1.368 | 43 | 43.43 | Corr. coeff. = 0.9967 |
| 8 | 2.3 | 2.3 | 4.6 | 1.096 | 34 | 34.34 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.859 | 23 | 23.23 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

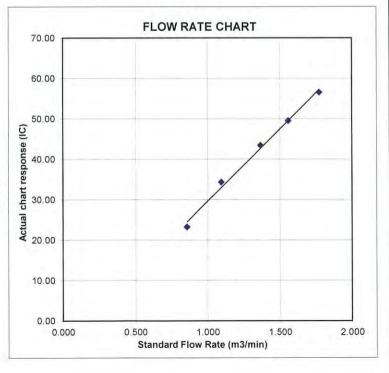

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 3Y6503

Equipment Ref: EQ112

Job Order HK1703461

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

| Hour | | | Concentration in mg/m³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) | |
|----------|---------------|------|---|---------------------------------------|--|------|
| 3hr14min | 09:10 ~ 12:24 | 20.6 | 1016.3 | 0.145 | 12647 | 65.3 |
| 1hr57min | 12:30 ~ 14:27 | 20.6 | 1016.3 | 0.069 | 3476 | 29.7 |
| 1hr58min | 14:35 ~ 16:33 | 20.6 | 1016.3 | 0.091 | 4876 | 41.0 |

Sensitivity Adjustment Scale Setting (Before Calibration) 654 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 658 (CPM)

Linear Regression of Y or X

Slope (K-factor): 0.0022

Correlation Coefficient 0.9997

Date of Issue 11 January 2017

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

| 0.16 | | | | |
|------|-----|----|----------------|----|
| 0.14 | | | | _ |
| 0.12 | | | / | - |
| 0.1 | | | | |
| 0.08 | | | | |
| 0.06 | | | 0022x+0.000 | 1 |
| 0.04 | -/- | | $R^2 = 0.9994$ | |
| 0.02 | / | | | _ |
| 0 | | | | - |
| | 20 | 40 | 60 | 80 |

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer: Ben Tam Signature: Date: 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16

Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa)1016.4Corrected Pressure (mm Hg)762.3Temperature (°C)20.0Temperature (K)293

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Calibration Date-> 14-Mar-16
Qstd Slope -> 2.00411
Qstd Intercept -> -0.03059
Expiry Date-> 14-Mar-17

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.776 | 56 | 56.56 | Slope = 35.6871 |
| 13 | 4.7 | 4.7 | 9.4 | 1.560 | 49 | 49.49 | Intercept = -6.1123 |
| 10 | 3.6 | 3.6 | 7.2 | 1.368 | 43 | 43.43 | Corr. coeff. = 0.9967 |
| 8 | 2.3 | 2.3 | 4.6 | 1.096 | 34 | 34.34 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.859 | 23 | 23.23 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

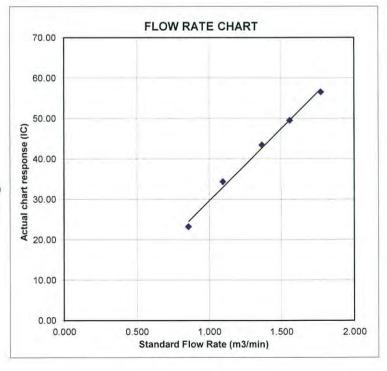

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 3Y6505

Equipment Ref: EQ114

Job Order HK1703464

Standard Equipment:

Standard Equipment: Higher Volume Sampler

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 25 November 2016

Equipment Verification Results:

Testing Date: 9 January 2017

| Hour | Time | Mean Temp °C | Mean Pressure (hPa) | Concentration in mg/m³ (Standard Equipment) | Total Count (Calibrated Equipment) | Count/Minute (Total Count/60min) |
|----------|---------------|-----------------|---------------------------|--|---------------------------------------|--|
| 3hr14min | 09:10 ~ 12:24 | 20.6 | 1016.3 | 0.145 | 12588 | 65.0 |
| 1hr57min | 12:30 ~ 14:27 | 20.6 | 1016.3 | 0.069 | 3339 | 28.5 |
| 1hr58min | 14:35 ~ 16:33 | 20.6 | 1016.3 | 0.091 | 4774 | 40.2 |


Sensitivity Adjustment Scale Setting (Before Calibration) 588 (CPM)
Sensitivity Adjustment Scale Setting (After Calibration) 587 (CPM)

Linear Regression of Y or X

 Slope (K-factor):
 0.0022

 Correlation Coefficient
 0.9992

 Date of Issue
 11 January 2017

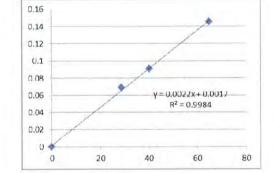

Remarks:

- 1. Strong Correlation (R>0.8)
- 2. Factor 0.0022 should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator: Martin Li Signature: Date: 11 January 2017

QC Reviewer : ____ Ben Tam ___ Signature : _____ Date : ___ 11 January 2017

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 25-Nov-16
Location ID: Calibration Room Next Calibration Date: 25-Feb-17

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1016.4 20.0

Corrected Pressure (mm Hg)
Temperature (K)

762.3 293

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Calibration Date-> 14-Mar-16

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.00411 -0.03059 14-Mar-17

CALIBRATION

| Plate | H20 (L) | H2O (R) | H20 | Qstd | I | IC | LINEAR |
|-------|---------|---------|------|----------|---------|-----------|-----------------------|
| No. | (in) | (in) | (in) | (m3/min) | (chart) | corrected | REGRESSION |
| 18 | 6.1 | 6.1 | 12.2 | 1.776 | 56 | 56.56 | Slope = 35.6871 |
| 13 | 4.7 | 4.7 | 9.4 | 1.560 | 49 | 49.49 | Intercept = -6.1123 |
| 10 | 3.6 | 3.6 | 7.2 | 1.368 | 43 | 43.43 | Corr. coeff. = 0.9967 |
| 8 | 2.3 | 2.3 | 4.6 | 1.096 | 34 | 34.34 | |
| 5 | 1.4 | 1.4 | 2.8 | 0.859 | 23 | 23.23 | |

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

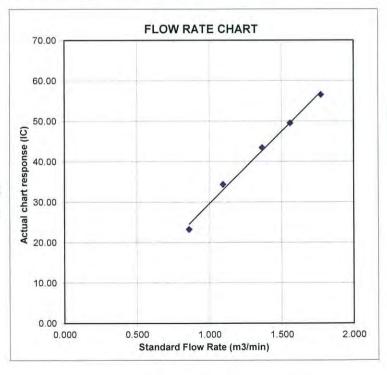



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. : C162996

 $(55 \pm 20)\%$

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC16-0843)

Date of Receipt / 收件日期: 26 May 2016

Description / 儀器名稱

Integrating Sound Level Meter (EQ065)

Manufacturer / 製造商

Brüel & Kjær

Model No. / 型號 Serial No./編號

2238 2337676

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)℃

Line Voltage / 電壓 :

Relative Humidity / 相對濕度 :

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

2 June 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Fluke Everett Service Center, USA
- Rohde & Schwarz Laboratory, Germany

Tested By

測試

HT Wong Technical Officer

Certified By 核證

KC Lee Date of Issue 簽發日期

6 June 2016

Project Engineer

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書而批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162996

證書編號

6.2 Time Weighting

6.2.1 Continuous Signal

| | UUT | Setting | | Applied Value | | UUT | IEC 60651 |
|---------------|------------------|------------------------|-------------------|---------------|-------------|--------------|----------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | L _{AFP} | A | F | 94.00 | 1 | 94.0 | Ref. |
| | L _{ASP} | | S | | | 94.1 | ± 0.1 |
| | L _{AIP} | | I | | | 94.1 | ± 0.1 |

6.2.2 Tone Burst Signal (2 kHz)

| | UUT | Setting | | App | lied Value | UUT | IEC 60651 |
|---------------|--------------------|------------------------|-------------------|---------------|-------------------|--------------|-------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Burst Duration | Reading (dB) | Type 1 Spec. (dB) |
| 30 - 110 | L _{AFP} | A | F | 106.0 | Continuous | 106.0 | Ref. |
| | L _{AFMax} | | | | 200 ms | 105.0 | -1.0 ± 1.0 |
| | L _{ASP} | | S | | Continuous | 106.0 | Ref. |
| | L _{ASMax} | | | | 500 ms | 102.0 | -4.1 ± 1.0 |

6.3 Frequency Weighting

6.3.1 A-Weighting

| | UUT | Setting | | Appli | ed Value | UUT | IEC 60651 |
|---------------|-----------|------------------------|-------------------|---------------|----------|--------------|--------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | LAFP | A | F | 94.00 | 31.5 Hz | 54.9 | -39.4 ± 1.5 |
| | | | | 63 Hz | 67.9 | -26.2 ± 1.5 | |
| | | | | | 125 Hz | 77.9 | -16.1 ± 1.0 |
| | | | | | 250 Hz | 85.4 | -8.6 ± 1.0 |
| | | | | | 500 Hz | 90.8 | -3.2 ± 1.0 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 95.2 | $+1.2 \pm 1.0$ |
| | | | | | 4 kHz | 95.0 | $+1.0 \pm 1.0$ |
| | | | | | 8 kHz | 92.9 | -1.1 (+1.5 ; -3.0) |
| | | | | | 12.5 kHz | 89.8 | -4.3 (+3.0; -6.0) |

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited — Calibration & Testing Laboratory c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 — 校正及檢測實驗所

c/o 香港新界屯門與安里一號青山灣機樓四樓

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162996

證書編號

6.3.2 C-Weighting

| | UUT | Setting | | Appli | ed Value | UUT | IEC 60651 |
|---------------|------------------|------------------------|-------------------|------------|----------|----------------|-------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | L _{CFP} | C | F | 94.00 | 31.5 Hz | 91.2 | -3.0 ± 1.5 |
| 3,33 | | | | 63 Hz | 93.2 | -0.8 ± 1.5 | |
| | | | | 125 Hz | 93.8 | -0.2 ± 1.0 | |
| | | | | | 250 Hz | 94.0 | 0.0 ± 1.0 |
| | | | | | 500 Hz | 94.0 | 0.0 ± 1.0 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 93.8 | -0.2 ± 1.0 |
| | | | | | 4 kHz | 93.2 | -0.8 ± 1.0 |
| | | | | | 8 kHz | 91.0 | -3.0 (+1.5; -3.0) |
| | | | | | 12.5 kHz | 87.9 | -6.2 (+3.0; -6.0) |

Time Averaging 6.4

| | UUT Setting | | | | A | | UUT | IEC 60804 | | |
|---------------|-------------|------------------------|---------------------|--------------------|---------------------------|-------------------------|------------------------|-----------------------------|--------------|-------------------------|
| Range (dB) | Parameter | Frequency Weighting | Integrating Time | Frequency (kHz) | Burst Duration (ms) | Burst Duty Factor | Burst Level (dB) | Equivalent Level (dB) | Reading (dB) | Type 1 Spec, (dB) |
| 30 - 110 | LAcq | A | 10 sec. | 4 | 1 | 1/10 | 110.0 | 100 | 100.2 | ± 0.5 |
| | | | | | | 1/102 | | 90 | 90.1 | ± 0.5 |
| | | | 60 sec. | | | 1/103 | | 80 | 79.8 | ± 1.0 |
| | | | 5 min. | | | 1/104 | 1 | 70 | 69.8 | ± 1.0 |

- UUT Microphone Model No.: 4188 & S/N: 2812708 Remarks:

- Mfr's Spec. : IEC 60651 Type 1 & IEC 60804 Type 1

94 dB : 31.5 Hz - 125 Hz : ± 0.35 dB - Uncertainties of Applied Value:

250 Hz - 500 Hz : ± 0.30 dB 1 kHz : ± 0.20 dB 2 kHz - 4 kHz : ± 0.35 dB 8 kHz : ± 0.45 dB

: ± 0.70 dB 12.5 kHz 104 dB: 1 kHz $: \pm 0.10 \text{ dB (Ref. 94 dB)}$

114 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB) $; \pm 0.2 \text{ dB}$ (Ref. 110 dB) Burst equivalent level continuous sound level)

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited - Calibration & Testing Laboratory

c/o 4/F, Tsing Shan Wan Exchange Building, 1 Hing On Lane, Tuen Mun, New Territories, Hong Kong 輝創工程有限公司 - 校正及檢測實驗所

c/o 香港新界屯門與安里一號青山灣機樓四樓

E-mail/電郵; callab@suncreation.com Website/網址: www.suncreation.com Tel/電話: 2927 2606 Fax/傳真: 2744 8986

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162991

證書編號

ITEM TESTED/送檢項目 (Job No./序引編號: IC16-0843)

Date of Receipt / 收件日期: 24 May 2016

Description / 儀器名稱

Sound Calibrator (EQ083)

Manufacturer / 製造商

Rion

Model No. / 型號

NC-74

Serial No. / 編號

34246492

Supplied By/委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature/溫度 : (23 ± 2)℃ Line Voltage / 電壓 :

Relative Humidity / 相對濕度 : $(55 \pm 20)\%$

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

2 June 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

HT Wong Technical Officer

Certified By 核證

K C/Lee

Date of Issue 簽發日期

3 June 2016

Project Engineer

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

c/o 香港新界屯門與安里一號青山灣機樓四樓

Tel/電話: 2927 2606 Fax/傳真: 2744 8986 E-mail/電郵: callab@suncreation.com Website 網址: www.suncreation.com



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162991

證書編號

The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement
of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

Equipment ID CL130 CL281 TST150A Description
Universal Counter
Multifunction Acoustic Calibrator
Measuring Amplifier

Certificate No. C153519 PA160023 C161175

Test procedure : MA100N.

5. Results:

5.1 Sound Level Accuracy

| UUT | Measured Value | Mfr's Spec. | Uncertainty of Measured Value |
|---------------|----------------|-------------|-------------------------------|
| Nominal Value | (dB) | | (dB) |
| 94 dB, 1 kHz | 94.0 | ± 0.3 | ± 0.2 |

5.2 Frequency Accuracy

| UUT Nominal Value | Measured Value | Mfr's | Uncertainty of Measured Value (Hz) |
|-------------------|----------------|-------------|------------------------------------|
| (kHz) | (kHz) | Spec. | |
| 1 | 1.001 | 1 kHz ± 1 % | ±1 |

Remark: The uncertainties are for a confidence probability of not less than 95 %.

Note:

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C161797

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC16-0662)

Date of Receipt / 收件日期: 22 March 2016

Description / 儀器名稱 : So

Sound Level Meter (EQ014)

Manufacturer / 製造商

Rion

Model No. / 型號 Serial No. / 編號

NL-52 00142580

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 : (23 ± 2)°C

Line Voltage/電壓: ---

Relative Humidity / 相對濕度 ; (55 ± 20)%

TEST SPECIFICATIONS / 測試規範

Calibration

DATE OF TEST / 測試日期 : 6 April 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification. (after adjustment)

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試 1

H T Wong Technical Officer

Certified By 核證

3

K C Lee

Project Engineer

Date of Issue 簽發日期 7 April 2016

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shalf not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No. :

C161797

證書編號

 The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

2. Self-calibration using the internal standard (After Adjustment) was performed before the test 6.1.1.2 to 6.3.2.

3. The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment:

Equipment ID

Description

Certificate No.

CL280 CL281 40 MHz Arbitrary Waveform Generator Multifunction Acoustic Calibrator C160077

Multifulction Acoustic Cal

PA160023

5. Test procedure: MA101N.

6. Results:

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Adjustment

| | UUT | Setting | | Applie | d Value | UUT | IEC 61672 | |
|---------------|----------|------------------------|-------------------|---------------|----------------|-----------------|-----------------------|--|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | Class I Spec. (dB) | |
| 30 - 130 | LA | A | Fast | 94.00 | 1 | * 91.9 | ±1.1 | |

^{*} Out of IEC 61672 Class 1 Spec.

6.1.1.2 After Adjustment

| | UUT | Setting | | Applie | d Value | UUT | IEC 61672 | |
|---------------|----------|------------------------|-------------------|------------|----------------|--------------|-----------------------|--|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | Class I Spec. (dB) | |
| 30 - 130 | LA | A | Fast | 94.00 | I | 94.0 | ± 1.1 | |

6.1.2 Linearity

| | UUT Setting | | | | d Value | UUT | |
|---------------|-------------|------------------------|-------------------|---------------|----------------|--------------|--|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | |
| 30 - 130 | LA | A | Fast | 94.00 | 1 | 94.0 (Ref.) | |
| | 1.0 | 1 1 | | 104.00 | | 104.0 | |
| | | | | 114.00 | | 114.0 | |

IEC 61672 Class 1 Spec. : ± 0.6 dB per 10 dB step and ± 1.1 dB for overall different.

The test equipment used for cambration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C161797

證書編號

6.2 Time Weighting

| | UUT Setting | | | Applied Value | | UUT | IEC 61672 |
|---------------|-------------|------------------------|-------------------|---------------|----------------|--------------|-----------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | Class 1 Spec. (dB) |
| 30 - 130 | LA | A | Fast | 94.00 | 1 | 94.0 | Ref. |
| | | | Slow | | | 94.0 | ± 0.3 |

6.3 Frequency Weighting

A-Weighting 6.3.1

| | UUT | Setting | | Appl | ied Value | UUT | IEC 61672 |
|---------------|----------------|------------------------|-------------------|---------------|-----------|--------------|-----------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. | Reading (dB) | Class 1 Spec. (dB) |
| 30 - 130 | L _A | A | Fast | 94.00 | 63 Hz | 67.7 | -26.2 ± 1.5 |
| | 100 | 1 | | | 125 Hz | 77.8 | -16.1 ± 1.5 |
| | | | | | 250 Hz | 85.3 | -8.6 ± 1.4 |
| | | | | | 500 Hz | 90.7 | -3.2 ± 1.4 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 95.2 | $+1.2 \pm 1.6$ |
| | | | | | 4 kHz | 95.0 | $+1.0 \pm 1.6$ |
| | | | | | 8 kHz | 92.9 | -1.1 (+2.1; -3.1) |
| | | | | | 12.5 kHz | 89.5 | -4.3 (+3.0; -6.0) |

C-Weighting 6.3.2

| | UUT | Setting | | Appl | ied Value | UUT | IEC 61672 |
|---------------|----------------|------------------------|-------------------|------------|-----------|--------------|-----------------------|
| Range (dB) | Function | Frequency Weighting | Time Weighting | Level (dB) | Freq. | Reading (dB) | Class 1 Spec. (dB) |
| 30 - 130 | L _C | L _C C | Fast | 94.00 | 63 Hz | 93.1 | -0.8 ± 1.5 |
| | - | | 10000 | | 125 Hz | 93.8 | -0.2 ± 1.5 |
| | | | | | 250 Hz | 94.0 | 0.0 ± 1.4 |
| | | | | | 500 Hz | 94.0 | 0.0 ± 1.4 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 93.8 | -0.2 ± 1.6 |
| | | | | | 4 kHz | 93.2 | -0.8 ± 1.6 |
| | | | | | 8 kHz | 91.0 | -3.0 (+2.1; -3.1 |
| | | | | | 12.5 kHz | 87.6 | -6.2 (+3.0 ; -6.0 |

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C161797

證書編號

Remarks: - UUT Microphone Model No.: UC-59 & S/N: 07725

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value: 94 dB : 63 Hz - 125 Hz : ± 0.35 dB

250 Hz - 500 Hz : ± 0.30 dB 1 kHz : ± 0.20 dB 2 kHz - 4 kHz : ± 0.35 dB 8 kHz : ± 0.45 dB

12.5 kHz : ± 0.70 dB

104 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB) 114 dB: 1 kHz $\pm 0.10 \text{ dB (Ref. 94 dB)}$

- The uncertainties are for a confidence probability of not less than 95 %.

Note:

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162177

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC16-0843)

Date of Receipt / 收件日期: 14 April 2016

Description / 儀器名稱

Integrating Sound Level Meter (EQ006)

Manufacturer / 製造商

Brüel & Kjær

Model No. /型號

2238

Serial No./編號

2285762

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 :

 $(23 \pm 2)^{\circ}C$

Relative Humidity / 相對濕度:

Line Voltage / 電壓:

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

25 April 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

- Agilent Technologies / Keysight Technologies

- Fluke Everett Service Center, USA

- Rohde & Schwarz Laboratory, Germany

Tested By

測試

HT Wong Technical Officer

Certified By

K C/Lee

Project Engineer

Date of Issue 簽發日期

27 April 2016

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本趋書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

Certificate No.: C162177

證書編號

The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to 1. warm up for over 10 minutes before the commencement of the test.

Self-calibration using laboratory acoustic calibrator was performed before the test from 6.1.1.2 to 6.4. 2.

3. The results presented are the mean of 3 measurements at each calibration point.

4. Test equipment:

Equipment ID

Description

Certificate No.

CL280 CL281

40 MHz Arbitrary Waveform Generator Multifunction Acoustic Calibrator

C160077 PA160023

5. Test procedure: MA101N.

Results: 6.

Sound Pressure Level 6.1

6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Self-calibration

| UUT Setting | | | | Applied | UUT | |
|---------------|-----------|------------------------|-------------------|------------|----------------|--------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) |
| 50 - 130 | LAFP | A | F | 94.00 | I | 94.2 |

6.1.1.2 After Self-calibration

| | UUT | Setting | | Applie | d Value | UUT | IEC 60651 |
|---------------|-----------|------------------------|-------------------|------------|----------------|-----------------|----------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | LAFP | A | F | 94.00 | 1 | 94.0 | ± 0.7 |

6.1.2 Linearity

| | UU'. | Γ Setting | | Applied | d Value | UUT |
|---------------|-----------|------------------------|-------------------|---------------|----------------|-----------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) |
| 50 - 130 | LAFP | A | F | 94.00 | 1 | 94.0 (Ref.) |
| | 7411 | | | 104.00 | | 104.0 |
| | | | | 114.00 | | 113.9 |

IEC 60651 Type I Spec. : \pm 0.4 dB per 10 dB step and \pm 0.7 dB for overall different.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No.: C162177

證書編號

6.2 Time Weighting

Continuous Signal 6.2.1

| | UUT | Setting | | Applie | d Value | UUT | IEC 60651 |
|---------------|-----------|------------------------|-------------------|---------------|----------------|-----------------|-------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. (kHz) | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | LAFP | A | F | 94.00 | 1 | 94.0 | Ref. |
| | LASP | | S | | | 94.0 | ± 0.1 |
| | LAIP | | 1 | | | 94.1 | ± 0.1 |

Tone Burst Signal (2 kHz) 6.2.2

| UUT Setting | | | Applied Value | | UUT | IEC 60651 | |
|---------------|--------------------|------------------------|-------------------|------------|-------------------|--------------|----------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Burst Duration | Reading (dB) | Type 1 Spec. (dB) |
| 30 - 110 | LAFP | A | F | 106.0 | Continuous | 106.0 | Ref. |
| | LAFMax | | | | 200 ms | 105.0 | -1.0 ± 1.0 |
| | L _{ASP} | | S | | Continuous | 106.0 | Ref. |
| | L _{ASMax} | | | | 500 ms | 102.0 | -4.1 ± 1.0 |

Frequency Weighting

6.3.1 A-Weighting

| | UUT | Setting | | Appli | ed Value | UUT | IEC 60651 |
|---------------|-----------|------------------------|-------------------|---------------|----------|--------------|----------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | LAFP | A | F | 94.00 | 31.5 Hz | 55.1 | -39.4 ± 1.5 |
| | | | | | 63 Hz | 67.9 | -26.2 ± 1.5 |
| | | | | | 125 Hz | 77.9 | -16.1 ± 1.0 |
| | | () | | | 250 Hz | 85.3 | -8.6 ± 1.0 |
| | | | | | 500 Hz | 90.7 | -3.2 ± 1.0 |
| | | | | | 1 kHz | 94.0 | Ref. |
| | | | | | 2 kHz | 95.2 | $+1.2 \pm 1.0$ |
| | | | | | 4 kHz | 95.0 | $+1.0 \pm 1.0$ |
| | | | | | 8 kHz | 91.0 | -1.1 (+1.5; -3.0) |
| | | | | | 12.5 kHz | 89.8 | -4.3 (+3.0 ; -6.0) |

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先發本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

Certificate No.: C162177

證書編號

C-Weighting 6.3.2

| | UUT | Setting | | Appli | ed Value | UUT | IEC 60651 |
|---------------|-----------|------------------------|-------------------|---------------|------------|--------------|-------------------|
| Range (dB) | Parameter | Frequency Weighting | Time Weighting | Level (dB) | Freq. | Reading (dB) | Type 1 Spec. (dB) |
| 50 - 130 | LCFP | C | F | 94.00 | 31.5 Hz | 91.5 | -3.0 ± 1.5 |
| | 5.00 | 6 | 63 Hz | 93.4 | -0.8 ± 1.5 | | |
| | | | | | | 125 Hz | 93.9 |
| | | | | | 250 Hz | 94.1 | 0.0 ± 1.0 |
| | | | | | 500 Hz | 94.1 | 0.0 ± 1.0 |
| | | 1. | 1 / | | 1 kHz | 94.1 | Ref. |
| | | | | | 2 kHz | 93.9 | -0.2 ± 1.0 |
| | | | | | 4 kHz | 93.2 | -0.8 ± 1.0 |
| | | | | | 8 kHz | 92.9 | -3.0 (+1.5; -3.0) |
| | | | | | 12.5 kHz | 87.9 | -6.2 (+3.0; -6.0) |

6.4 Time Averaging

| | UUT | Setting | | Applied Value | | | UUT | IEC 60804 | | |
|---------------|-----------|------------------------|---------------------|--------------------|---------------------------|-------------------------|------------------------|-----------------------------|-----------------|-------------------------|
| Range (dB) | Parameter | Frequency Weighting | Integrating Time | Frequency (kHz) | Burst Duration (ms) | Burst Duty Factor | Burst Level (dB) | Equivalent Level (dB) | Reading (dB) | Type 1 Spec. (dB) |
| 30 - 110 | LAcq | A | 10 sec. | 4 | 1 | 1/10 | 110.0 | 100 | 100.0 | ±0.5 |
| | | | | | | 1/102 | | 90 | 89.9 | ± 0.5 |
| | | | 60 sec. | | | 1/103 | | 80 | 79.2 | ±1.0 |
| | | | 5 min. | | | 1/104 | | 70 | 69.2 | ±1.0 |

Remarks: - UUT Microphone Model No.: 4188 & S/N: 2812705

- Mfr's Spec. : IEC 60651 Type 1 & IEC 60804 Type 1

- Uncertainties of Applied Value : 94 dB : 31.5 Hz - 125 Hz : ± 0.35 dB

250 Hz - 500 Hz : ± 0.30 dB : ± 0.20 dB 1 kHz 2 kHz - 4 kHz : ± 0.35 dB 8 kHz : ± 0.45 dB

12.5 kHz ; ± 0.70 dB

104 dB: I kHz : ± 0.10 dB (Ref. 94 dB) 114 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB) ; ± 0.2 dB (Ref. 110 dB Burst equivalent level continuous sound level)

Note:


The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

c/o 香港新界屯門興安里一號青山灣機權四樓

⁻ The uncertainties are for a confidence probability of not less than 95 %.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可測源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No.: C162438

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC16-0843)

Date of Receipt / 收件日期: 5 May 2016

Description / 儀器名稱

Acoustical Calibrator (EQ081)

Manufacturer / 製造商

Brüel & Kjær

Model No. / 型號 Serial No./編號

4231 2326408

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 :

Relative Humidity / 相對濕度 : (55 ± 20)%

Line Voltage / 電壓:

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

10 May 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only. The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

HT Wong

Certified By

核證

Technical Officer

Date of Issue 簽發日期

11 May 2016

K C Lee Project Engineer

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162438

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

Equipment IDDescriptionCertificate No.CL130Universal CounterC153519CL281Multifunction Acoustic CalibratorPA160023TST150AMeasuring AmplifierC161175

Test procedure : MA100N.

5. Results:

5.1 Sound Level Accuracy

| UUT Nominal Value | Measured Value (dB) | Mfr's Spec. (dB) | Uncertainty of Measured Value (dB) |
|----------------------|------------------------|---------------------|---------------------------------------|
| 94 dB, 1 kHz | 94.0 | ± 0.2 | ± 0.2 |
| 114 dB, 1 kHz | 114.0 | | |

5.2 Frequency Accuracy

| UUT Nominal Value | Measured Value | Mfr's | Uncertainty of Measured Value |
|-------------------|----------------|---------------|-------------------------------|
| (kHz) | (kHz) | Spec. | (Hz) |
| 1 | 1.000 0 | 1 kHz ± 0.1 % | ± 0.1 |

Remark: The uncertainties are for a confidence probability of not less than 95 %.

Note:

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration

校正證書

Certificate No.: C162125

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC16-0843)

Date of Receipt / 收件日期: 14 April 2016

Description / 儀器名稱

Acoustical Calibrator (EQ082)

Manufacturer/製造商 Model No. / 型號

Brüel & Kjær

Serial No. / 編號

4231 2713428

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 : Line Voltage / 電壓 :

Relative Humidity / 相對濕度 : $(55 \pm 20)\%$

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 22 April 2016

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA

Tested By 測試

HT Wong Technical Officer

Certified By 核證

K C/Lee

Project Engineer

Date of Issue 簽發日期

25 April 2016

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Sun Creation Engineering Limited

Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C162125

證書編號

The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement
of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

Equipment ID
CL130Description
Universal CounterCertificate No.
C153519CL281Multifunction Acoustic Calibrator
Measuring AmplifierPA160023
C161175

4. Test procedure: MA100N.

5. Results:

5.1 Sound Level Accuracy

| UUT Nominal Value | Measured Value (dB) | Mfr's Spec. (dB) | Uncertainty of Measured Value (dB) |
|----------------------|------------------------|---------------------|------------------------------------|
| 94 dB, 1 kHz | 94.0 | ± 0.2 | ± 0.2 |
| 114 dB, 1 kHz | 114.1 | | |

5.2 Frequency Accuracy

| UUT Nominal Value | Measured Value | Mfr's | Uncertainty of Measured Value |
|-------------------|----------------|---------------|-------------------------------|
| (kHz) | (kHz) | Spec. | (Hz) |
| 1 | 1.000 0 | 1 kHz ± 0.1 % | ± 0.1 |

Remark ! The uncertainties are for a confidence probability of not less than 95 %.

Note:

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書寫先獲本實驗所書面批准。



ALS Technichem (HK) Pty Ltd

11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong T+852 2610 1044 F+852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:

MR BEN TAM

CLIENT: ADDRESS:

ACTION UNITED ENVIRO SERVICES RM A 20/F., GOLD KING IND BLDG,

NO. 35-41 TAI LIN PAI ROAD,

KWAI CHUNG.

N.T., HONG KONG.

WORK ORDER: HK1645660

SUB-BATCH:

LABORATORY: DATE RECEIVED: HONG KONG

DATE OF ISSUE:

11/11/2016 16/11/2016

COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the ALS Hong Kong laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principals as practised by the ALS Hong Kong laboratory or quoted from relevant international standards.

Scope of Test:

Dissolved Oxygen and Temperature

Equipment Type:

Dissolved Oxygen Meter

Brand Name:

YSI

Model No.:

Pro 20

Serial No.:

12C100570

Equipment No.:

Date of Calibration: 14 November, 2016

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr. Fung Lim Chee

General Manager

Greater China & Hong Kong

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

Work Order: HK1645660

Sub-Batch:

Date of Issue: 16/11/2016

Client: ACTION UNITED ENVIRO SERVICES

Equipment Type: Dissolved Oxygen Meter

Brand Name: YSI
Model No.: Pro 20
Serial No.: 12C100570

Equipment No.: --

Date of Calibration: 14 November, 2016 Date of next Calibration: 14 February, 2017

Parameters:

Dissolved Oxygen Method Ref: APHA (21st edition), 45000: G

| Expected Reading (mg/L) | Displayed Reading (mg/L) | Tolerance (mg/L) |
|-------------------------|--------------------------|------------------|
| 4.00 | 3.88 | -0.12 |
| 6.50 | 6.37 | -0.13 |
| 8.36 | 8.20 | -0.16 |
| 100 | Tolerance Limit (mg/L) | ±0.20 |

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

| Expected Reading (°C) | Displayed Reading (°C) | Tolerance (°C) |
|------------------------|-------------------------|-----------------|
| 7.5 | 8.2 | +0.7 |
| 24.0 | 23.1 | -0.9 |
| 41.5 | 42.3 | +0.8 |
| | Tolerance Limit (°C) | ±2.0 |

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless

of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard General Manager -

Greater China & Hong Kong



ALS Technichem (HK) Pty Ltd

11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street Kwai Chung, N.T., Hong Kong T +852 2610 1044 F +852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM

CLIENT: **ACTION UNITED ENVIRO SERVICES**

ADDRESS: RM A 20/F., GOLDEN KING IND BLDG,

NO. 35-41 TAI LIN PAI ROAD,

KWAI CHUNG. N.T., HONG KONG WORK ORDER: HK1645662

SUB-BATCH:

LABORATORY: HONG KONG DATE RECEIVED: 11/11/2016

DATE OF ISSUE: 16/11/2016

COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the ALS Hong Kong laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principals as practised by the ALS Hong Kong laboratory or quoted from relevant international standards.

Scope of Test:

pH and Temperature

Description:

pH Meter

Brand Name:

AZ

Model No .: Serial No.:

8685

Equipment No.:

1064457

Date of Calibration: 14 November, 2016

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

> Mr Fung Lim Chee, General Manager

Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

Work Order: HK1645662

Sub-batch:

Date of Issue: 16/11/2016

Client: **ACTION UNITED ENVIRO SERVICES**

Description: pH Meter

AZ Brand Name: Model No.: 8685 Serial No.: 1064457

Equipment No.:

Date of next Calibration: Date of Calibration: 14 November, 2016 14 February, 2017

Parameters:

pH Value Method Ref: APHA (21st edition), 4500H:B

| Expected Reading (pH Unit) | Displayed Reading (pH Unit) | Tolerance (pH unit) |
|----------------------------|-----------------------------|---------------------|
| 4.0 | 4.1 | +0.10 |
| 7.0 | 7.1 | +0.10 |
| 10.0 | 9.8 | -0.20 |
| | Tolerance Limit (pH Unit) | ±0,20 |

Temperature Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

| Expected Reading (°C) | Displayed Reading (°C) | Tolerance (°C) |
|------------------------|-------------------------|----------------|
| 6.5 | 6.5 | +0.0 |
| 24.0 | 23.5 | -0.5 |
| 38.0 | 37.5 | -0.5 |
| | Tolerance Limit (°C) | ±2.0 |

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

> Mr Fung Lim Chee, Richard General Manager

Greater China & Hong Kong



ALS Technichem (HK) Pty Ltd 11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street

Kwai Chung, N.T., Hong Kong T+852 2610 1044 <u>F</u>+852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM WORK ORDER: HK1645701

CLIENT: ACTION UNITED ENVIRO SERVICES SUB-BATCH: 0

ADDRESS: RM A 20/F., GOLD KING IND BLDG, LABORATORY: HONG KONG

NO. 35-41 TAI LIN PAI ROAD, **DATE RECEIVED**: 11/11/2016 KWAI CHUNG, **DATE OF ISSUE**: 15/11/2016

N.T., HONG KONG

COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the ALS Hong Kong laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principals as practised by the ALS Hong Kong laboratory or quoted from relevant international standards.

Scope of Test: Turbidity
Equipment Type: Turbidimeter

Brand Name: HACH Model No.: 21000

Serial No.: 11030C008499

Equipment No.: --

Date of Calibration: 12 November, 2016

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.

Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr. Fung Lim Chee, Richard

General Manager

Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

Work Order: HK1645701

Sub-batch: 0

Date of Issue: 15/11/2016

Client: **ACTION UNITED ENVIRO SERVICES**

Equipment Type: Turbidimeter

HACH Brand Name: Model No .: 2100Q

11030C008499 Serial No .:

Equipment No.:

Date of next Calibration: 12 February, 2017 Date of Calibration: 12 November, 2016

Parameters:

Turbidity Method Ref: APHA 21st Ed. 2130B

| Expected Reading (NTU) | Displayed Reading (NTU) | Tolerance (%) | |
|------------------------|-------------------------|---------------|--|
| | | | |
| 0 | 0.76 | | |
| 4 | 4.29 | +7.3 | |
| 40 | 43.4 | +8.5 | |
| 80 | 86.2 | +7.8 | |
| 400 | 410 | +2.5 | |
| 800 | 852 | +6.5 | |
| | Tolerance Limit (%) | ±10.0 | |

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard

General Manager

Greater China & Hong Kong



Appendix G

Event and Action Plan



Event and Action Plan for Air Quality

| Event | ET | IEC | ER | Action Contractor |
|---|---|---|--|--|
| Action Level | | | | |
| Exceedance for one sample | Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. | Check monitoring data submitted by ET; Check Contractor's working method. | Notify Contractor. | Rectify any unacceptable practice; Amend working methods if appropriate. |
| Exceedance for two or more consecutive samples | Identify source; | 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Monitor the implementation of remedial measures. | Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. | Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal appropriate. |
| Limit Level | | | | |
| Exceedance for one sample | investigate the causes of exceedance and propose remedial measures; 2. Inform ER, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. | Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Monitor theimplementation of remedial measures. | Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. | 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal appropriate. |
| Exceedance for two or more consecutive samples | | submitted by ET; 2. Check Contractor's working method; 3. Discuss amongst ER, ET, and Contractor on the polential remedial actions; 4. Review Contractor's remedial actions whenever necessary to assure their | Confrm receipt of notification of failure in writing; Notify Contractor; In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; | 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not |
| | and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. | the ER accordingly; 5. Monitor the implementation of remedial measures. | 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. | under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated. |



Event and Action Plan for Construction Noise

| Event | ET | IEC | ER | Action Contractor |
|-----------------|--|--|--|---|
| Action Level | Notify ER, IEC and Contractor; Carry out investigation; Report the results of investigation to the IEC, ER and Contractor; Discuss with the IEC and Contractor on remedial measures required; Increase monitoring frequency to check mitigation effectiveness. | Review the investigation results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the ER accordingly; Advise the ER on the effectiveness of the proposed remedial measures. | Confirm receipt of notification of failure in writing; Notify Contractor; In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; Supervise the implementation of remedial measures. | Submit noise mitigation proposals to IEC and ER; Implement noise mitigation proposals. |
| Limit Level | 1. Inform IEC, ER, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and ER on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. | Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly. | 1. Confirm receipt of notification of failure in writing: 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated. | 1. Take immediate action to avoid further exceedance: 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated. |



Event and Action Plan for Water Quality

| Action level | 1. Repeat in-situ | 1. Discuss with ET and | 1. Discuss with IEC on | ACTION CONTRACTOR 1. Inform the ER and confirm |
|---|--|--|---|---|
| being exceeded by one sampling day | measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and Contractor; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC and Contractor; 6. Repeat measurement on next day of exceedance. | Contractor on the mitigation measures; 2. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; 3. Assess the effectiveness of the implemented mitigation measures | the proposed mitigation measures; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures | notification of the non- compliance in writing; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Discuss with ET and IEC and propose mitigation measures to IEC and ER; 6. Implement the agreed mitigation measures. |
| Action Level being exceeded by more than two consecutive sampling days | 1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and Contractor; 4. Check monitoring data, all plant, equipment and Contractor's working methods mitigation measures with IEC and Contractor; 6. Ensure mitigation measures are implemented; 7. Prepare to increase the monitoring frequency to daily; 8. Repeat measurement on next day of | Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures | Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures | Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER within 2 working riese. Implement the agreed mitigation measures. |
| Limit Level being exceeded by one sampling day | exceedance. 1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC, Contractor and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, ER and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit | Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assass the effectiveness of the implemented mitigation measures | Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures. | Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Chock all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures. |
| Limit level being exceeded by more than one consecutive sampling days | Level. 1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC, Contractor and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, ER and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days. | Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. | 1. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 2. Request Contractor to critically review the working methods; 3. Make agreement on the mitigation measures to be implemented; 4. Assess the effectiveness of the implemented mitigation measures; 5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit Level. | Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures; As directed by the ER, to slow down or to stop all or part of the construction activities. |



Appendix H

Impact Monitoring Schedule



Impact Monitoring Schedule for Reporting Period – January 2017

| | Date | Dust Mo | onitoring | Noise Monitoring | Water Quality |
|------------|------------------------|-------------------------------|-------------------------------|-------------------------------|---|
| | Date | 1-hour TSP | 24-hour TSP | Noise Wolftoning | water Quanty |
| Sun | 1-Jan-17 | | | | |
| Mon | 2-Jan-17 | | AM1L AM2 AM2 P | | All Water Orollite Manifesting |
| Tue | 3-Jan-17 | | AM1b, AM2, AM3 & AM9b | | All Water Quality Monitoring Locations |
| Wed | 4-Jan-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | NM1, NM2a, NM8, NM9 & NM10 | |
| Thu | 5-Jan-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | All Water Quality Monitoring Locations |
| Fri | 6-Jan-17 | | | | |
| Sat | 7-Jan-17 | | | | All Water Quality Monitoring Locations |
| Sun | 8-Jan-17 | | | | |
| Mon | 9-Jan-17 | | AM1b, AM2, AM3 & AM9b | | |
| Tue | 10-Jan-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | NM1, NM2a, NM8, NM9 & NM10 | All Water Quality Monitoring Locations |
| Wed | 11-Jan-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | |
| Thu | 12-Jan-17 | | | | All Water Quality Monitoring Locations |
| Fri | 13-Jan-17 | | | | |
| Sat | 14-Jan-17 | | AM1b, AM2, AM3 & AM9b | | All Water Quality Monitoring Locations |
| Sun | 15-Jan-17 | | | | |
| Mon | 16-Jan-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | NM1, NM2a, NM8, NM9 & NM10 | |
| Tue | 17-Jan-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | All Water Quality Monitoring Locations |
| Wed | 18-Jan-17 | | | | |
| Thu | 19-Jan-17 | | | | All Water Quality Monitoring Locations |
| Fri | 20-Jan-17 | | AM1b, AM2, AM3 & AM9b | | |
| Sat | 21-Jan-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | | All Water Quality Monitoring Locations |
| Sun | 22-Jan-17 | | | | |
| Mon | 23-Jan-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | All Water Quality Monitoring Locations |
| Tue | 24-Jan-17 | | | | |
| Wed | 25-Jan-17 | | | | All Water Quality Monitoring Locations |
| Thu | 26-Jan-17 | AM1b, AM2, AM3 & AM9b | AM1b, AM2, AM3 & AM9b | NM1, NM2a, NM8, NM9 & NM10 | |
| Fri | 27-Jan-17 | AM4b, AM5, AM6, AM7b & AM8 | AM4b, AM5, AM6, AM7b & AM8 | | All Water Quality Monitoring Locations |
| Sat | 28-Jan-17 | | | | |
| Sun | 29-Jan-17 | | | | |
| Mon Tue | 30-Jan-17 31-Jan-17 | | | | |
| <u> </u> | | | | <u> </u> | |

Remark: As confirmed by all Contractor, there were no adverse water impact works carried out during Chinese new year holiday and therefore no water quality monitoring was schedule on 30 and 31 January 2017.

| Monitoring Day |
|--------------------------|
| Sunday or Public Holiday |



Impact Monitoring Schedule for next Reporting Period – February 2017

| | Date | Dust Mo | onitoring | Noise Menitorine | Water Or alite |
|-----|-----------|-------------------------------|-------------------------------|-------------------------------|---|
| | Date | 1-hour TSP | 24-hour TSP | Noise Monitoring | Water Quality |
| WED | 1-FEB-17 | AM1b, AM2, AM3 & AM9b | AM1b, AM2, AM3 & AM9b | NM1, NM2a, NM8, NM9 & NM10 | |
| THU | 2-FEB-17 | AM4b, AM5, AM6, AM7b & AM8 | AM4b, AM5, AM6, AM7b & AM8 | NM3, NM4, NM5, NM6 & NM7 | All Water Quality Monitoring Locations |
| FRI | 3-FEB-17 | | | | |
| SAT | 4-FEB-17 | | | | All Water Quality Monitoring Locations |
| SUN | 5-FEB-17 | | | | |
| Mon | 6-FEB-17 | | AM1b, AM2, AM3 & AM9b | | |
| TUE | 7-FEB-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | NM1, NM2a, NM8, NM9 & NM10 | All Water Quality Monitoring Locations |
| WED | 8-FEB-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | |
| THU | 9-FEB-17 | | | | All Water Quality Monitoring Locations |
| FRI | 10-FEB-17 | | | | |
| SAT | 11-FEB-17 | | AM1b, AM2, AM3 & AM9b | | All Water Quality Monitoring Locations |
| SUN | 12-FEB-17 | | | | |
| Mon | 13-FEB-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | NM1, NM2a, NM8, NM9 & NM10 | All Water Quality Monitoring Locations |
| TUE | 14-FEB-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | |
| WED | 15-FEB-17 | | | | All Water Quality Monitoring Locations |
| THU | 16-FEB-17 | | | | |
| FRI | 17-FEB-17 | | AM1b, AM2, AM3 & AM9b | | All Water Quality Monitoring Locations |
| SAT | 18-FEB-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | | |
| SUN | 19-FEB-17 | | | | |
| Mon | 20-FEB-17 | AM4b, AM5, AM6, AM7b & AM8 | | NM3, NM4, NM5, NM6 & NM7 | All Water Quality Monitoring Locations |
| TUE | 21-FEB-17 | | | | |
| WED | 22-FEB-17 | | | | All Water Quality Monitoring Locations |
| THU | 23-FEB-17 | | AM1b, AM2, AM3 & AM9b | | |
| FRI | 24-FEB-17 | AM1b, AM2, AM3 & AM9b | AM4b, AM5, AM6, AM7b & AM8 | NM1, NM2a, NM8, NM9 & NM10 | All Water Quality Monitoring Locations |
| SAT | 25-FEB-17 | AM4b, AM5, AM6, AM7b & AM8 | | | |
| SUN | 26-FEB-17 | | | | |
| Mon | 27-FEB-17 | | | | All Water Quality Monitoring Locations |
| TUE | 28-FEB-17 | | | | |

| Monitoring Day |
|--------------------------|
| Sunday or Public Holiday |



Appendix I

Database of Monitoring Result



24-hour TSP Monitoring Data

| DATE | SAMPLE | EL | APSED TIM | 1 E | | CHAR READII | | AVG TEMP | AVG AIR PRESS | STANDARD FLOW RATE | AIR VOLUME | FILTER V | | DUST WEIGHT COLLECTED | 24-HR TSP |
|-----------------------|---------------|--------------|--------------|------------|---------|----------------|------|-------------|------------------|-----------------------|-----------------------|----------|--------|--------------------------|---------------|
| DATE | NUMBER | INITIAL | FINAL | (min) | MI N | MAX | AVG | (℃) | (hPa) | (m³/min) | (std m ³) | INITIAL | FINAL | (g) | $(\mu g/m^3)$ |
| AM1b – O _l | pen Area, Tsi | ung Yuen H | Ia Village | | | | | | | | | | | | |
| 3-Jan-17 | 20375 | 12504.77 | 12528.48 | 1422.60 | 46 | 48 | 47.0 | 20 | 1019.8 | 1.61 | 2297 | 2.8002 | 3.0160 | 0.2158 | 94 |
| 9-Jan-17 | 20384 | 12528.48 | 12552.24 | 1425.60 | 44 | 46 | 45.0 | 20.6 | 1016.3 | 1.53 | 2181 | 2.8009 | 3.0499 | 0.2490 | 114 |
| 14-Jan-17 | 20417 | 12552.24 | 12576.39 | 1449.00 | 44 | 44 | 44.0 | 15.7 | 1017.9 | 1.51 | 2182 | 2.7973 | 2.9188 | 0.1215 | 56 |
| 20-Jan-17 | 20426 | 12576.39 | 12600.54 | 1449.00 | 44 | 45 | 44.5 | 18.3 | 1022.4 | 1.52 | 2206 | 2.7987 | 3.0719 | 0.2732 | 124 |
| 26-Jan-17 | 20436 | 12600.54 | 12624.68 | 1448.40 | 44 | 45 | 44.5 | 17.3 | 1024.3 | 1.53 | 2212 | 2.7772 | 2.9348 | 0.1576 | 71 |
| AM2 - Villa | age House ne | ar Lin Ma | Hang Road | | | | | | | | | | | | |
| 3-Jan-17 | 20361 | 8022.61 | 8046.11 | 1410.00 | 40 | 40 | 40.0 | 20 | 1019.8 | 1.31 | 1847 | 2.8110 | 3.0829 | 0.2719 | 147 |
| 9-Jan-17 | 20383 | 8046.11 | 8069.61 | 1410.00 | 36 | 36 | 36.0 | 20.6 | 1016.3 | 1.18 | 1667 | 2.7798 | 2.8354 | 0.0556 | 33 |
| 14-Jan-17 | 20394 | 8069.41 | 8093.23 | 1429.20 | 36 | 37 | 36.5 | 15.7 | 1017.9 | 1.21 | 1727 | 2.7840 | 2.8922 | 0.1082 | 63 |
| 20-Jan-17 | 20425 | 8093.23 | 8117.04 | 1428.60 | 36 | 36 | 36.0 | 18.3 | 1022.4 | 1.19 | 1700 | 2.7871 | 3.0060 | 0.2189 | 129 |
| 26-Jan-17 | 20455 | 8117.04 | 8140.78 | 1424.40 | 37 | 37 | 37.0 | 17.3 | 1024.3 | 1.22 | 1744 | 2.8057 | 3.0079 | 0.2022 | 116 |
| AM3 - Ta I | Kwu Ling Fir | re Service S | tation of Ta | Kwu Lin | g Vil | lage | | | | | | | | | |
| 3-Jan-17 | 20360 | 9164.14 | 9188.14 | 1440.00 | 54 | 54 | 54.0 | 20 | 1019.8 | 1.64 | 2355 | 2.8243 | 3.0538 | 0.2295 | 97 |
| 9-Jan-17 | 20382 | 9188.14 | 9212.14 | 1440.00 | 54 | 54 | 54.0 | 20.6 | 1016.3 | 1.63 | 2348 | 2.7904 | 3.0671 | 0.2767 | 118 |
| 14-Jan-17 | 20393 | 9212.14 | 9236.14 | 1440.00 | 52 | 52 | 52.0 | 15.7 | 1017.9 | 1.58 | 2273 | 2.7808 | 3.0115 | 0.2307 | 101 |
| 20-Jan-17 | 20424 | 9236.14 | 9260.14 | 1440.00 | 55 | 55 | 55.0 | 18.3 | 1022.4 | 1.68 | 2416 | 2.7883 | 3.0850 | 0.2967 | 123 |
| 26-Jan-17 | 20435 | 9260.14 | 9284.14 | 1440.00 | 52 | 52 | 52.0 | 17.3 | 1024.3 | 1.58 | 2274 | 2.7790 | 3.0659 | 0.2869 | 126 |
| AM4b - Ho | ouse no. 10B1 | Nga Yiu H | la Village | | | | | | | | | | • | | |
| 4-Jan-17 | 20378 | 11169.46 | 11193.46 | 1440.00 | 44 | 44 | 44.0 | 19.9 | 1018.7 | 1.32 | 1898 | 2.8148 | 2.9627 | 0.1479 | 78 |
| 10-Jan-17 | 20386 | 11193.46 | 11217.46 | 1440.00 | 43 | 43 | 43.0 | 19.4 | 1018.1 | 1.29 | 1860 | 2.7983 | 2.9399 | 0.1416 | 76 |
| 16-Jan-17 | 20421 | 11217.46 | 11241.46 | 1440.00 | 42 | 42 | 42.0 | 16.3 | 1020.4 | 1.27 | 1831 | 2.7855 | 2.8656 | 0.0801 | 44 |
| 21-Jan-17 | 20430 | 11241.46 | 11265.46 | 1440.00 | 42 | 42 | 42.0 | 16.7 | 1025.3 | 1.27 | 1834 | 2.7875 | 2.9100 | 0.1225 | 67 |
| 27-Jan-17 | 20457 | 11265.46 | 11289.47 | 1440.60 | 46 | 46 | 46.0 | 17.5 | 1022.6 | 1.38 | 1988 | 2.8220 | 2.9313 | 0.1093 | 55 |
| AM5a - Pir | ng Yeung Vill | lage House | | | | | | | | | | | | | |
| 4-Jan-17 | 20379 | 9016.12 | 9040.12 | 1440.00 | 47 | 47 | 47.0 | 19.9 | 1018.7 | 1.53 | 2201 | 2.7941 | 2.9552 | 0.1611 | 73 |
| 10-Jan-17 | 20387 | 9040.12 | 9064.12 | 1440.00 | 47 | 47 | 47.0 | 19.4 | 1018.1 | 1.53 | 2202 | 2.7913 | 2.9930 | 0.2017 | 92 |
| 16-Jan-17 | 20422 | 9064.12 | 9088.12 | 1440.00 | 34 | 34 | 34.0 | 16.3 | 1020.4 | 1.13 | 1626 | 2.7805 | 2.8815 | 0.1010 | 62 |
| 21-Jan-17 | 20431 | 9088.12 | 9112.12 | 1440.00 | 52 | 52 | 52.0 | 16.7 | 1025.3 | 1.70 | 2446 | 2.7902 | 3.0265 | 0.2363 | 97 |
| 27-Jan-17 | 20458 | 9112.12 | 9136.14 | 1441.20 | 52 | 52 | 52.0 | 17.5 | 1022.6 | 1.69 | 2442 | 2.8220 | 3.0979 | 0.2759 | 113 |
| AM6 - Wo | Keng Shan V | | | | | | | | | | | | | | |
| 4-Jan-17 | 20377 | 7598.39 | 7622.39 | 1440.00 | 44 | 44 | 44.0 | 19.9 | 1018.7 | 1.40 | 2010 | 2.7933 | 2.9373 | 0.1440 | 72 |
| 10-Jan-17 | 20388 | 7622.39 | 7646.39 | 1440.00 | 48 | 48 | 48.0 | 19.4 | 1018.1 | 1.51 | 2181 | 2.7828 | 2.9753 | 0.1925 | 88 |



| DATE | SAMPLE | EL | APSED TIM | 1E | | CHAR EADII | | AVG TEMP | AVG AIR PRESS | STANDARD FLOW RATE | AIR VOLUME | FILTER V | | DUST WEIGHT COLLECTED | 24-HR TSP |
|------------|----------------|------------|-----------|---------|---------|---------------|------|-------------|------------------|-----------------------|-----------------------|----------|--------|--------------------------|---------------|
| DATE | NUMBER | INITIAL | FINAL | (min) | MI N | MAX | AVG | (℃) | (hPa) | (m ³ /min) | (std m ³) | INITIAL | FINAL | (g) | $(\mu g/m^3)$ |
| 16-Jan-17 | 20419 | 7646.39 | 7670.39 | 1440.00 | 50 | 50 | 50.0 | 16.3 | 1020.4 | 1.58 | 2280 | 2.7858 | 2.9640 | 0.1782 | 78 |
| 21-Jan-17 | 20428 | 7670.39 | 7694.39 | 1440.00 | 50 | 52 | 51.0 | 16.7 | 1025.3 | 1.62 | 2327 | 2.7967 | 3.1357 | 0.3390 | 146 |
| 27-Jan-17 | 20459 | 7694.39 | 7718.40 | 1440.60 | 50 | 52 | 51.0 | 17.5 | 1022.6 | 1.61 | 2322 | 2.8061 | 2.9605 | 0.1544 | 67 |
| 4-Jan-17 | 20377 | 7598.39 | 7622.39 | 1440.00 | 44 | 44 | 44.0 | 19.9 | 1018.7 | 1.40 | 2010 | 2.7933 | 2.9373 | 0.1440 | 72 |
| AM7b - Lo | i Tung Villag | ge House | | | | | | | | | | | | | |
| 4-Jan-17 | 20380 | 16634.65 | 16658.64 | 1439.40 | 34 | 34 | 34.0 | 19.9 | 1018.7 | 0.77 | 1108 | 2.7828 | 2.8909 | 0.1081 | 98 |
| 10-Jan-17 | 20389 | 16658.64 | 16682.64 | 1440.00 | 34 | 36 | 35.0 | 19.4 | 1018.1 | 0.80 | 1153 | 2.7820 | 2.9320 | 0.1500 | 130 |
| 16-Jan-17 | 20420 | 16682.64 | 16706.64 | 1440.00 | 34 | 34 | 34.0 | 16.3 | 1020.4 | 0.78 | 1119 | 2.7925 | 2.8480 | 0.0555 | 50 |
| 21-Jan-17 | 20429 | 16706.64 | 16730.64 | 1440.00 | 34 | 34 | 34.0 | 17.3 | 1025.3 | 0.78 | 1120 | 2.7887 | 2.9449 | 0.1562 | 139 |
| 27-Jan-17 | 20460 | 16730.64 | 16754.65 | 1440.60 | 34 | 34 | 34.0 | 18.3 | 1022.6 | 0.77 | 1116 | 2.8080 | 2.9189 | 0.1109 | 99 |
| AM8 - Po I | Kat Tsai Villa | ige No. 4 | | | | | | | | | | | | | |
| 4-Jan-17 | 20381 | 10541.19 | 10565.19 | 1440.00 | 42 | 42 | 42.0 | 19.9 | 1018.7 | 1.06 | 1533 | 2.7997 | 2.8895 | 0.0898 | 59 |
| 10-Jan-17 | 20390 | 10565.19 | 10589.19 | 1440.00 | 44 | 44 | 44.0 | 19.4 | 1018.1 | 1.12 | 1620 | 2.7929 | 2.9007 | 0.1078 | 67 |
| 16-Jan-17 | 20423 | 10589.19 | 10613.19 | 1440.00 | 42 | 42 | 42.0 | 16.3 | 1020.4 | 1.07 | 1546 | 2.7822 | 2.8169 | 0.0347 | 22 |
| 21-Jan-17 | 20432 | 10613.19 | 10637.19 | 1440.00 | 38 | 38 | 38.0 | 16.7 | 1025.3 | 0.96 | 1377 | 2.7740 | 2.8747 | 0.1007 | 73 |
| 27-Jan-17 | 20461 | 10637.19 | 10661.20 | 1440.60 | 42 | 42 | 42.0 | 17.5 | 1022.6 | 1.07 | 1545 | 2.8003 | 2.8881 | 0.0878 | 57 |
| AM9b - Na | m Wa Po Vil | lage House | No. 80 | | | | | | | | | | | | |
| 3-Jan-17 | 20376 | 17920.41 | 17944.41 | 1440.00 | 30 | 30 | 30.0 | 20 | 1019.8 | 1.08 | 1554 | 2.8001 | 2.8947 | 0.0946 | 61 |
| 9-Jan-17 | 20385 | 17944.41 | 17968.41 | 1440.00 | 34 | 34 | 34.0 | 20.6 | 1016.3 | 1.19 | 1719 | 2.7941 | 2.8827 | 0.0886 | 52 |
| 14-Jan-17 | 20418 | 17968.41 | 17992.42 | 1440.60 | 30 | 30 | 30.0 | 15.7 | 1017.9 | 1.08 | 1563 | 2.8042 | 2.8599 | 0.0557 | 36 |
| 20-Jan-17 | 20427 | 17992.42 | 18016.42 | 1440.00 | 30 | 30 | 30.0 | 18.3 | 1022.4 | 1.08 | 1559 | 2.7929 | 2.8877 | 0.0948 | 61 |
| 26-Jan-17 | 20456 | 18016.42 | 18040.42 | 1440.00 | 26 | 26 | 26.0 | 17.3 | 1024.3 | 0.97 | 1392 | 2.7872 | 2.8539 | 0.0667 | 48 |



Construction Noise Monitoring Results, dB(A)

| Date | Start Time | 1 st Leq _{5mi} | L10 | L90 | 2 nd Leq _{5min} | L10 | L90 | 3 nd Leq _{5min} | L10 | L90 | 4 th Leq _{5min} | L10 | L90 | 5 th Leq _{5min} | L10 | L90 | 6 th Leq _{5min} | L10 | L90 | Leq30 | façade correction |
|---------------------------------|---------------|---------------------------------------|----------|---------|--|------|------|--|--------------|------|--|------|------|--|-------------------|------|--|------|--------------|-------|----------------------|
| NM1 - Tsung | Yuen | Ha Vill | age Hou | ıse No. | 63 | | | | | | | | | | | | | | | | |
| 4-Jan-17 | 10:30 | 54.6 | 56.4 | 52.3 | 54.9 | 56.8 | 51.9 | 53.0 | 54.6 | 51.0 | 52.9 | 54.5 | 49.9 | 52.6 | 54.5 | 50.2 | 52.9 | 54.8 | 50.4 | 54 | NA |
| 10-Jan-17 | 9:16 | 55.3 | 56.5 | 52.0 | 53.6 | 54.5 | 51.5 | 53.0 | 54.0 | 49.5 | 54.1 | 55.5 | 50.5 | 54.1 | 55.5 | 51.5 | 54.7 | 56.0 | 51.5 | 54 | NA |
| 16-Jan-17 | 10:25 | 54.7 | 56.0 | 52.1 | 55.4 | 57.4 | 53.0 | 55.6 | 57.7 | 52.8 | 56.1 | 58.5 | 53.2 | 56.1 | 58.2 | 53.3 | 53.1 | 53.6 | 52.7 | 55 | NA |
| 26-Jan-17 | 10:03 | 56.4 | 60.1 | 48.3 | 51.3 | 53.6 | 48.3 | 52.7 | 55.3 | 48.7 | 53.1 | 55.8 | 48.7 | 52.2 | 53.8 | 47.8 | 70.4 | 77.5 | 49.8 | 63 | NA |
| NM2a - Villa | ge Hot | | · Lin Ma | | Road | | | | | | | | | | | | | | | | |
| 4-Jan-17 | 9:22 | 62.8 | 65.9 | 55.6 | 64.2 | 67.0 | 54.6 | 63.6 | 66.8 | 55.2 | 63.8 | 67.1 | 55.5 | 68.9 | 72.8 | 57.8 | 67.1 | 70.7 | 58.3 | 66 | 69 |
| 10-Jan-17 | 10:00 | 64.4 | 68.0 | 48.5 | 56.2 | 59.0 | 49.5 | 55.0 | 58.5 | 48.5 | 70.6 | 74.0 | 49.0 | 74.2 | 78.0 | 49.0 | 51.1 | 53.0 | 48.5 | 68 | 71 |
| 16-Jan-17 | 9:52 | 63.9 | 66.1 | 52.6 | 62.4 | 63.5 | 52.4 | 60.3 | 64.7 | 52.1 | 62.0 | 66.3 | 52.3 | 61.3 | 64.9 | 52.2 | 55.7 | 59.7 | 51.9 | 62 | 65 |
| 26-Jan-17 | 9:28 | 69.7 | 68.6 | 60.9 | 64.0 | 66.2 | 61.5 | 63.4 | 64.1 | 61.2 | 64.7 | 67.9 | 61.6 | 64.7 | 66.8 | 61.2 | 64.5 | 66.3 | 61.2 | 66 | 69 |
| NM3 - Ping Y | | | | | 1 | | | 1 | | ı | 1 1 | | T | 1 | | | T | I I | | T | |
| - | 10:00 | | 64.5 | 60.0 | 60.0 | 60.5 | 59.0 | 59.4 | 60.5 | 58.0 | 58.6 | 59.5 | 57.5 | 58.7 | 59.5 | 57.5 | 58.5 | 59.5 | 57.5 | 60 | NA |
| 11-Jan-17 | 9:41 | 61.8 | 62.7 | 52.4 | 59.7 | 62.8 | 51.3 | 61.7 | 63.8 | 50.5 | 61.2 | 63.8 | 50.3 | 60.9 | 63.1 | 51.7 | 59.2 | 61.3 | 50.1 | 61 | NA |
| 17-Jan-17 | 13:07 | 62.4 | 64.1 | 53.1 | 61.1 | 63.7 | 52.8 | 64.2 | 66.3 | 51.1 | 60.4 | 62.8 | 51.6 | 62.4 | 65.7 | 50.4 | 59.2 | 61.1 | 49.2 | 62 | NA |
| 1 | 11:44 | 63.8 | 64.5 | 61.5 | 62.4 | 63.5 | 60.5 | 61.5 | 62.5 | 60.3 | 62.7 | 63.5 | 61.2 | 63.6 | 63.8 | 61.7 | 63.4 | 62.7 | 60.9 | 63 | NA |
| NM4 - Wo Ko | | | | | 60.0 | 65.0 | | | 65.0 | | 64.6 | 60.0 | | | 65.0 | | | 60.7 | 7 0.0 | | 3.7.1 |
| 5-Jan-17 | 9:18 | 65.2 | 66.5 | 58.0 | 63.8 | 67.0 | 57.5 | 63.6 | 67.0 | 57.0 | 64.6 | 68.0 | 57.5 | 64.4 | 67.0 | 56.5 | 65.5 | 68.5 | 58.0 | 65 | NA |
| 11-Jan-17 | 10:31 | 67.1 | 66.3 | 54.0 | 58.1 | 67.9 | 55.4 | 72.3 | 68.7 | 53.1 | 66.5 | 69.4 | 58.1 | 68.6 | 70.5 | 54.5 | 63.0 | 65.7 | 54.6 | 68 | NA |
| 17-Jan-17 | 14:02 | 61.1 | 63.4 | 55.2 | 64.6 | 65.7 | 57.4 | 60.8 | 62.7 | 58.1 | 62.4 | 65.7 | 59.2 | 61.7 | 63.0 | 57.1 | 64.6 | 67.1 | 57.8 | 63 | NA |
| | 11:17 | 64.5 | 61.9 | 48.9 | 63.7 | 61.2 | 48.5 | 62.5 | 58.3 | 49.1 | 68.0 | 71.8 | 51.7 | 64.5 | 63.8 | 49.6 | 63.8 | 61.7 | 48.2 | 65 | NA |
| NM5– Ping Y | | | | 42.5 | 51.0 | 55.0 | 12.5 | 50.4 | <i>5</i> 2.0 | 44.0 | 47.4 | 10.5 | 12.5 | 57.5 | (0.5 | 115 | 5(1 | 50.5 | 16.5 | 54 | NIA |
| 5-Jan-17 | 10:44 | 53.9 | 52.0 | | | 55.0 | 43.5 | 50.4 | 52.0 | 44.0 | 47.4 | 49.5 | 43.5 | 57.5 | 60.5 | 44.5 | 56.1 | 59.5 | 46.5 | | NA |
| 11-Jan-17 | 9:37 | 54.8 | 57.0 | 46.5 | 60.9 | 64.0 | 46.0 | 59.1 | 63.5 | 48.5 | 53.9 | 56.5 | 46.0 | 59.1 | 61.5 | 48.0 | 66.2 | 67.5 | 47.5 | 61 | NA NA |
| 17-Jan-17 | 9:39 | 55.1 | 58.1 | 47.6 | 58.1 | 60.4 | 48.5 | 56.2 | 58.4 | 49.1 | 57.2 | 59.2 | 48.6 | 60.4 | 62.5 | 49.3 | 55.0 | 57.1 | 50.4 | 57 | NA |
| 23-Jan-17 | 10:40 | | 55.2 | 48.4 | 53.8 | 54.5 | 47.8 | 54.4 | 55.1 | 48.7 | 50.4 | 53.0 | 46.1 | 52.0 | 55.3 | 48.5 | 53.1 | 56.0 | 47.5 | 53 | NA |
| NM6 – Tai To 5-Jan-17 | 11:23 | | 59.0 | 53.0 | 57.8 | 59.5 | 52.5 | 60.1 | 61.0 | 51.0 | 54.4 | 56.5 | 51.0 | 62.6 | 65.0 | 50.0 | 58.6 | 61.0 | 49.0 | 59 | NA |
| 3-Jan-17 11-Jan-17 | 10:21 | 53.4 | 46.0 | 44.0 | 61.2 | 67.0 | 49.5 | 65.2 | 70.0 | 52.5 | 62.3 | 63.0 | 50.0 | 63.7 | 68.5 | 45.5 | 59.4 | 63.0 | 44.5 | 62 | NA NA |
| | 10:21 | 55.1 | 57.6 | 49.2 | 53.1 | 55.6 | 47.1 | 60.9 | 62.3 | 52.3 | 54.2 | 56.3 | 50.0 | 54.0 | 56.7 | 47.2 | 58.1 | 59.6 | 50.4 | 57 | NA NA |
| | 10:23 | | 59.2 | 49.2 | 56.5 | 59.4 | 48.4 | 56.6 | 59.5 | 47.0 | 57.5 | 60.7 | 49.6 | 56.7 | 59.4 | 49.4 | 57.7 | 60.8 | 47.8 | 57 | NA NA |
| | | | 39.2 | 40.0 | 30.3 | 39.4 | 40.4 | 30.0 | 39.3 | 47.0 | 31.3 | 00.7 | 49.0 | 30.7 | 39.4 | 49.4 | 31.1 | 00.8 | 47.8 | 31 | INA |
| NM7 – Po Ka 5-Jan-17 | 12:58 | | 63.5 | 48.5 | 56.5 | 57.0 | 48.0 | 66.6 | 69.0 | 49.0 | 57.0 | 57.5 | 48.0 | 66.0 | 64.0 | 49.0 | 63.6 | 65.5 | 50.5 | 63 | NA |
| J-Jall-1/ | 14.38 | 37.7 | 05.5 | 40.3 | 20.3 | 37.0 | 40.0 | 0.00 | U7.U | 47.U | 37.0 | 31.3 | 40.0 | 0.00 | U 4 .U | 47.U | 03.0 | 05.5 | JU.J | US | INA |



| Date | Start Time | $1^{st} \atop Leq_{5mi} \atop {}_{n}$ | L10 | L90 | 2 nd Leq _{5min} | L10 | L90 | 3 nd Leq _{5min} | L10 | L90 | 4 th Leq _{5min} | L10 | L90 | 5 th Leq _{5min} | L10 | L90 | 6 th Leq _{5min} | L10 | L90 | Leq30 | façade correction |
|--------------|---|---------------------------------------|---------|--------|--|------|------|--|------|------|--|------|------|--|------|------|--|------|------|-------|----------------------|
| 11-Jan-17 | 12:55 | 54.2 | 56.5 | 48.0 | 66.0 | 59.5 | 50.0 | 59.6 | 62.5 | 47.5 | 54.4 | 57.5 | 46.0 | 59.0 | 59.0 | 50.0 | 54.2 | 57 | 46 | 60 | NA |
| 17-Jan-17 | 11:16 | 58.4 | 62.1 | 49.1 | 57.3 | 60.4 | 51.6 | 57.9 | 59.2 | 50.4 | 59.3 | 61.1 | 48.2 | 61.2 | 64.8 | 52.4 | 57.5 | 59.2 | 50.4 | 59 | NA |
| 23-Jan-17 | 9:22 | 60.2 | 63.1 | 51.2 | 61.8 | 64.8 | 50.7 | 58.9 | 61.9 | 50.0 | 57.0 | 61.7 | 50.0 | 61.4 | 63.1 | 51.4 | 58 | 62.7 | 50.5 | 60 | NA |
| NM8 - Villag | e Hous | se, Tong | g Hang | | | | | | | | | | | | | | | | | | |
| 4-Jan-17 | 9:53 | 57.4 | 63.2 | 47.1 | 59.6 | 65.7 | 48.8 | 58.9 | 64.8 | 48 | 57.5 | 63.9 | 47.5 | 59.1 | 65.8 | 48 | 58.5 | 64.7 | 48.6 | 59 | NA |
| 10-Jan-17 | 9:48 | 57 | 56 | 51.7 | 59.3 | 58 | 52.9 | 57.3 | 56.3 | 51.8 | 56 | 55.2 | 51 | 54.9 | 53.7 | 50.7 | 55.3 | 54.7 | 50.1 | 57 | NA |
| 16-Jan-17 | 10:04 | 58.5 | 60.2 | 51.1 | 59.8 | 65.7 | 62.7 | 58 | 62.1 | 51.5 | 58.2 | 64.7 | 50.7 | 59.5 | 65.4 | 50.1 | 57 | 61.4 | 50.4 | 59 | NA |
| 26-Jan-17 | 9:45 | 58.2 | 62.3 | 50.1 | 59.9 | 63.2 | 51.5 | 58.4 | 62.6 | 50 | 56.7 | 60.5 | 49.1 | 58.7 | 62.7 | 49 | 57.8 | 61.7 | 49 | 58 | NA |
| NM9 - Villag | 26-Jan-17 9:45 58.2 62.3 50.1 59.9 63.2 51.5 58.4 62.6 50 56.7 60.5 49.1 58.7 62.7 49 57.8 61.7 49 58 NA NM9 - Village House, Kiu Tau Village | | | | | | | | | | | | | | | | | | | | |
| 4-Jan-17 | 10:39 | 64.8 | 67.2 | 59.1 | 64.9 | 66.5 | 59.8 | 62.8 | 64.6 | 58.7 | 60.7 | 63.4 | 57.9 | 61.4 | 63.6 | 58.4 | 60.1 | 62.5 | 57.0 | 63 | NA |
| 10-Jan-17 | 10:34 | 65.3 | 67.1 | 58.6 | 61.5 | 63.8 | 57.0 | 62.1 | 64.7 | 57.0 | 64.7 | 66.5 | 58.4 | 63.5 | 65.8 | 57.7 | 62.1 | 64.5 | 57.1 | 63 | NA |
| 16-Jan-17 | 10:50 | 63.9 | 66.3 | 58.1 | 64.5 | 66.0 | 57.7 | 63.8 | 66.4 | 57.5 | 64.9 | 67.0 | 58.6 | 64.8 | 67.5 | 58.9 | 62.7 | 66.5 | 57.5 | 64 | NA |
| 26-Jan-17 | 10:28 | 63.8 | 66.1 | 58.6 | 64.6 | 66.6 | 57.9 | 61.0 | 64.8 | 56.0 | 60.1 | 63.7 | 56.1 | 62.1 | 65.5 | 57.7 | 60.4 | 62.1 | 56.5 | 62 | NA |
| NM10 - Nam | Wa Po | o Villag | e House | No. 80 | | | | | | | | | | | | | | | | | |
| 4-Jan-17 | 11:23 | 62.4 | 63.3 | 60.6 | 62.6 | 63.0 | 60.6 | 63.9 | 64.9 | 61.7 | 62.0 | 63.8 | 60.9 | 61.4 | 62.1 | 59.0 | 62.4 | 63.8 | 60.5 | 63 | 66 |
| 10-Jan-17 | 11:20 | 66.4 | 70.3 | 61.6 | 64.9 | 68.7 | 61.2 | 65.1 | 68.9 | 60.8 | 62.1 | 63.5 | 60.4 | 63.6 | 64.0 | 61.2 | 64.7 | 65.4 | 61.8 | 65 | 68 |
| 16-Jan-17 | 11:37 | 62.6 | 63.3 | 60.1 | 62.9 | 63.0 | 60.8 | 62.9 | 63.5 | 60.7 | 61.6 | 63.7 | 60.0 | 66.5 | 69.8 | 61.5 | 64.7 | 67.7 | 61.4 | 64 | 67 |
| 26-Jan-17 | 11:13 | 62.3 | 63.1 | 60.7 | 62.4 | 65.5 | 60.7 | 62.6 | 63.7 | 60.8 | 61.8 | 63.5 | 60.5 | 61.8 | 62.6 | 59.0 | 60.7 | 61.0 | 59.6 | 62 | 65 |



Noise Monitoring Results for Restricted Hour, dB(A)

| Noise Monitoring 1 | Testino Ioi II | Evening Tim | | | | | | Nic | ght Time | | |
|---------------------|----------------|---------------------|------|------|--|-----------|------------|---------------------|----------|------|--|
| Date | Start Time | Leq _{5min} | L10 | L90 | façade correction Leq _{5min} | Date | Start Time | Leq _{5min} | L10 | L90 | façade correction Leq _{5min} |
| NM4 - Wo Keng Sha | n Village Hous | se | | | _ | | | | _ | | |
| 6-Jan-17 | 22:31 | 42.3 | 44.9 | 38.9 | 6-Jan-17 | | | | | | |
| 13-Jan-17 | 21:57 | 53.1 | 50.7 | 30.2 | 13-Jan-17 | | | | | | |
| 20-Jan-17 | 21:53 | 55.8 | 52.8 | 33.1 | 20-Jan-17 | - | | - | | | |
| 26-Jan-17 | 21:55 | 45.9 | 49.1 | 34 | 26-Jan-17 | | | | | | |
| NM5- Ping Yeung Vi | | | | - | | | | | | | |
| 6-Jan-17 | 22:51 | 47.4 | 50.3 | 41.2 | NA | 6-Jan-17 | 23:00 | 53.0 | 57.9 | 42.4 | NA |
| 13-Jan-17 | 22:09 | 47.3 | 51.1 | 36.0 | NA | 13-Jan-17 | 23:00 | 45.6 | 48.6 | 37.3 | NA |
| 20-Jan-17 | 22:06 | 44.5 | 48.2 | 38.3 | NA | 20-Jan-17 | 23:00 | 46.2 | 49.7 | 38.2 | NA |
| 26-Jan-17 | 22:10 | 46.6 | 49.7 | 40.0 | NA | 26-Jan-17 | 23:01 | 45.0 | 48.4 | 38.8 | NA |
| NM7 – Po Kat Tsai V | /illage | | | | | | | | | | |
| 6-Jan-17 | 21:59 | 45.3 | 45.4 | 42.1 | NA | 6-Jan-17 | 23:16 | 45.0 | 44.6 | 41.9 | NA |
| 13-Jan-17 | 21:39 | 48.7 | 50.0 | 42.8 | NA | 13-Jan-17 | 23:17 | 49.4 | 50.2 | 46.2 | NA |
| 20-Jan-17 | 21:31 | 51.3 | 51.6 | 40.9 | NA | 20-Jan-17 | 23:16 | 45.5 | 48.9 | 41.3 | NA |
| 26-Jan-17 | 21:39 | 48.6 | 51.4 | 45.1 | NA | 26-Jan-17 | 23:16 | 55.2 | 53.7 | 49.6 | NA |
| NM8 - Village House | e, Tong Hang | | | | | | | | | | |
| 6-Jan-17 | 21:28 | 57.1 | 59.5 | 46.3 | NA | 6-Jan-17 | 23:41 | 56.4 | 59.5 | 44.0 | NA |
| 13-Jan-17 | 21:07 | 64.3 | 66.2 | 43.8 | NA | 13-Jan-17 | 23:37 | 58.8 | 57.2 | 43.7 | NA |
| 20-Jan-17 | 21:00 | 59.1 | 65.5 | 44.1 | NA | 20-Jan-17 | 23:40 | 55.6 | 53.5 | 44.8 | NA |
| 26-Jan-17 | 21:05 | 60.1 | 65.9 | 44.5 | NA | 26-Jan-17 | 23:37 | 57.9 | 51.1 | 45.4 | NA |
| NM9 - Village House | , Kiu Tau Vill | age | | | | | | | | | |
| | | | | | | 20-Jan-17 | 0:00 | 65.6 | 67.3 | 52.7 | NA |
| | | | | | | 27-Jan-17 | 0:00 | 60.2 | 63.5 | 53.1 | NA |
| NM10 - Nam Wa Po | Village House | No. 80 | | , | | | | | | | |
| | | | | | | 21-Jan-17 | 0:06 | 58 | 61 | 62.7 | 58.8 |
| | | | | | | 27-Jan-17 | 0:05 | 59.1 | 62.1 | 64.4 | 59.2 |



Water Quality Monitoring Data for Contract 6 and SS C505

| Date | 3-Jan-17 | | - | | _ | = | = | • | - | • | • | • | • | • |
|----------|----------|-----------|------|-----------|------|-------|------|------|--------------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | Temp (oC) | | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(r | ng/L) |
| WM1-C | 10:00 | 0.34 | 18.5 | 18.5 | 7.93 | 8.0 | 84.5 | 84.8 | 3.8 | 2.0 | 9.3 | 0.2 | 4 | 4.0 |
| | 10.00 | 0.34 | 18.5 | 16.3 | 8 | 8.0 | 85.1 | 04.0 | 3.7 | 3.8 | 9.3 | 9.3 | 4 | 4.0 |
| WM1 | 10:10 | 0.26 | 19.5 | 19.5 | 8.07 | 8.1 | 87.9 | 88.2 | 26.0 | 26.7 | 8.7 | 9.7 | 22 | 22.0 |
| WIVII | 10.10 | 0.20 | 19.5 | 19.3 | 8.12 | 0.1 | 88.4 | 00.2 | 27.3 | 20.7 | 8.7 | 8.7 | 22 | 22.0 |

| Date | 5-Jan-17 | - | • | | | | _ | | • | • | | • | | • |
|----------|----------|-----------|------|------|-------|-------|------|------|----------|------------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (ı | ng/L) | DO | (%) | Turbidit | ty (NTU) | p | H | SS(r | ng/L) |
| WM1-C | 10.00 | 0.24 | 19.7 | 10.7 | 7.46 | 7.5 | 80.6 | 90.7 | 6.0 | <i>E E</i> | 9.4 | 0.4 | 2 | 2.0 |
| | 10:00 | 0.34 | 19.7 | 19.7 | 7.48 | 7.3 | 80.7 | 80.7 | 5.1 | 5.5 | 9.4 | 9.4 | 2 | 2.0 |
| 3373.41 | 10.10 | 0.26 | 20.1 | 20.1 | 7.56 | 7.6 | 83.3 | 92.4 | 18.7 | 10.1 | 9.3 | 0.3 | 17 | 17.0 |
| WM1 | 10:10 | 0.26 | 20.1 | 20.1 | 7.57 | 7.6 | 83.4 | 83.4 | 17.5 | 18.1 | 9.3 | 9.3 | 17 | 17.0 |

| Date | 7-Jan-17 | - | - | | 3- | ∃ - | • | | • | | | • | | |
|----------|----------|-----------|------|-----------|------|------------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | Temp (oC) | | ng/L) | DO | (%) | Turbidit | y (NTU) | р | H | SS(n | ng/L) |
| WM1-C | 10.00 | 0.24 | 19.6 | 10.6 | 7.68 | 77 | 83.6 | 92.7 | 4.2 | 4.2 | 8.5 | 0.5 | <2 | ٠, |
| | 10:00 | 0.34 | 19.6 | 19.6 | 7.66 | 7.7 | 83.8 | 83.7 | 4.1 | 4.2 | 8.5 | 8.5 | <2 | <2 |
| WM1 | 10:10 | 0.26 | 20.5 | 20.5 | 7.55 | 7.5 | 83.7 | 84.0 | 18.8 | 18.9 | 8.1 | 8.1 | 18 | 18.5 |
| W IVI I | 10.10 | 0.20 | 20.5 | 20.3 | 7.52 | 7.3 | 84.2 | 84.0 | 18.9 | 18.9 | 8.1 | 0.1 | 19 | 16.3 |

| Date | 10-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(r | ng/L) |
| WM1 C | 10.00 | 0.24 | 19.6 | 10.6 | 7.38 | 7.4 | 80.5 | 90.6 | 4.8 | 4.6 | 9.3 | 0.2 | 2 | 2.5 |
| WM1-C | 10:00 | 0.34 | 19.6 | 19.6 | 7.39 | 7.4 | 80.6 | 80.6 | 4.4 | 4.6 | 9.3 | 9.3 | 3 | 2.5 |
| WM1 | 10:10 | 0.26 | 20.2 | 20.2 | 7.51 | 7.5 | 82.8 | 82.9 | 35.5 | 36.4 | 8.5 | 0.5 | 39 | 38.5 |
| VV IVI I | 10.10 | 0.20 | 20.2 | 20.2 | 7.53 | 7.3 | 83.0 | 82.9 | 37.2 | 30.4 | 8.5 | 8.5 | 38 | 36.3 |

| Date | 12-Jan-17 | · - | • | | - | • | • | • | • | • | • | • | • | |
|----------|-----------|----------------|------|--------|-------|-------|------|------|----------|---------|-----|-----|------|--------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | р | H | SS(r | ng/L) |
| WM1-C | 10:00 | 0.24 | 19.1 | 19.1 | 6.82 | 6.0 | 73.4 | 73.5 | 5.0 | 4.7 | 9.3 | 9.3 | <2 | \sim |
| W WIT-C | 10.00 | 0.34 | 19.1 | 19.1 | 6.83 | 6.8 | 73.5 | 73.3 | 4.4 | 4.7 | 9.3 | 9.3 | <2 | ~2 |
| WM1 | 10:10 | 0.26 | 20 | 20.0 | 7.89 | 8.0 | 86.9 | 87.8 | 38.9 | 39.5 | 7.7 | 7.7 | 37 | 38.0 |
| VV IVI I | 10.10 | 0.20 | 20 | 20.0 | 8.01 | 0.0 | 88.6 | 07.0 | 40.1 | 39.3 | 7.7 | 1.7 | 39 | 36.0 |



| Date | 14-Jan-17 | | - | | | | | | - | • | | - | • | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (ı | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(r | ng/L) |
| WM1-C | 0.11 | 0.34 | 15.5 | 15.5 | 9.64 | 9.7 | 96.9 | 97.4 | 4.9 | 5.0 | 9.5 | 0.5 | <2 | 2.0 |
| W WIT-C | 9:11 | 0.34 | 15.5 | 13.3 | 9.7 | 9.7 | 97.8 | 97.4 | 5.0 | 3.0 | 9.5 | 9.5 | 2 | 2.0 |
| WM1 | 9:27 | 0.20 | 15.8 | 15.8 | 9.15 | 9.2 | 93.6 | 94.2 | 49.9 | 50.5 | 9.2 | 9.2 | 40 | 40.5 |
| VV IVI I | 9.27 | 0.20 | 15.8 | 13.8 | 9.21 | 9.2 | 94.8 | 94.2 | 51.0 | 30.3 | 9.2 | 9.2 | 41 | 40.3 |

| Date | 17-Jan-17 | • | - | | _ | ∃ - | • | • | -5 | • | | • | | |
|------------|-----------|-----------|------|--------|-------|------------|------|------|---------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (ı | ng/L) | DO | (%) | Turbidi | ty (NTU) | р | H | SS(r | ng/L) |
| WM1-C | 10.00 | 0.24 | 16.9 | 16.0 | 8.55 | 9.6 | 88.1 | 88.3 | 3.9 | 2.0 | 9 | 0.0 | 2 | 2.0 |
| W IVI I -C | 10:00 | 0.34 | 16.9 | 16.9 | 8.57 | 8.6 | 88.4 | 88.3 | 3.8 | 3.8 | 9 | 9.0 | 2 | 2.0 |
| WM1 | 10:10 | 0.26 | 17.4 | 17.4 | 8.83 | 8.8 | 92.2 | 92.1 | 29.0 | 28.3 | 8.1 | 8.2 | 24 | 25.0 |
| VV IVI I | 10.10 | 0.20 | 17.4 | 17.4 | 8.81 | 0.0 | 92.0 | 92.1 | 27.6 | 26.3 | 8.2 | 0.2 | 26 | 25.0 |

| Date | 19-Jan-17 | - | | | | | - | | - | | | - | • | • |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | y (NTU) | р | H | SS(r | ng/L) |
| WM1 C | 10.00 | 0.24 | 20.2 | 20.2 | 7.6 | 7.5 | 82.9 | 92.2 | 4.3 | 4.2 | 9 | 0.0 | <2 | -2 |
| WM1-C | 10:00 | 0.34 | 20.2 | 20.2 | 7.47 | 7.3 | 81.4 | 82.2 | 4.3 | 4.3 | 9 | 9.0 | <2 | <2 |
| 3373.41 | 10.15 | 0.26 | 20.2 | 20.2 | 8.21 | 0.2 | 90.6 | 00.7 | 30.5 | 20.0 | 8.9 | 9.0 | 33 | 22.0 |
| WM1 | 10:15 | 0.26 | 20.2 | 20.2 | 8.24 | 8.2 | 90.8 | 90.7 | 31.0 | 30.8 | 8.9 | 8.9 | 33 | 33.0 |

| Date | 21-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | ty (NTU) | p | H | SS(r | ng/L) |
| WM1 C | 0.21 | 0.25 | 15.5 | 15.6 | 8.89 | 9.0 | 89.1 | 90.7 | 4.2 | 4.1 | 9.3 | 0.3 | <2 | -2 |
| WM1-C | 9:21 | 0.35 | 15.7 | 15.6 | 8.94 | 8.9 | 90.3 | 89.7 | 4.0 | 4.1 | 9.3 | 9.3 | <2 | <2 |
| WM1 | 9:37 | 0.19 | 16 | 16.0 | 9.25 | 9.3 | 93.8 | 94.1 | 9.8 | 9.8 | 8.9 | 8.9 | 3 | 4.0 |
| VV IVI I | 9.57 | 0.19 | 16 | 10.0 | 9.27 | 9.3 | 94.3 | 94.1 | 9.9 | 9.8 | 8.9 | 8.9 | 5 | 4.0 |

| Date | 23-Jan-17 | <u>-</u> | - | | | - | - | | - | | | <u>-</u> | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|---------|-----|----------|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | H | SS(r | ng/L) |
| WM1 C | 10.00 | 0.24 | 15.1 | 15.1 | 8.69 | 0.7 | 86.3 | 96.4 | 5.0 | 4.0 | 8.3 | 0.2 | <2 | -2 |
| WM1-C | 10:00 | 0.34 | 15.1 | 15.1 | 8.7 | 8.7 | 86.4 | 86.4 | 4.6 | 4.8 | 8.3 | 8.3 | <2 | <2 |
| WM1 | 10.10 | 0.26 | 15.6 | 15.6 | 9.81 | 0.0 | 98.6 | 98.8 | 10.9 | 11 1 | 7.8 | 7.0 | 8 | 9.0 |
| VV IVI I | 10:10 | 0.26 | 15.6 | 15.6 | 9.84 | 9.8 | 98.9 | 96.8 | 11.3 | 11.1 | 7.8 | 7.8 | 10 | 9.0 |



| Date | 25-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | р | H | SS(n | ng/L) |
| WM1 C | 10.00 | 0.24 | 18 | 10.0 | 7.52 | 7.6 | 79.2 | 70.5 | 4.4 | 4.1 | 9 | 0.0 | <2 | -2 |
| WM1-C | 10:00 | 0.34 | 18 | 18.0 | 7.58 | 7.6 | 79.7 | 79.5 | 3.8 | 4.1 | 9 | 9.0 | <2 | <2 |
| WM1 | 10:10 | 0.26 | 17.5 | 17.5 | 8.77 | 8.8 | 91.2 | 92.2 | 24.5 | 24.3 | 9.2 | 9.2 | 19 | 19.0 |
| VV 1VI I | 10.10 | 0.26 | 17.5 | 17.3 | 8.91 | 0.8 | 93.1 | 92.2 | 24.0 | 24.3 | 9.2 | 9.2 | 19 | 19.0 |

| Date | 27-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(r | ng/L) |
| WM1-C | 10:00 | 0.34 | 16.5 | 16.5 | 7.86 | 7.9 | 80.0 | 80.1 | 7.9 | 7.4 | 9.2 | 9.2 | 7 | 8.0 |
| W WIT-C | 10.00 | 0.34 | 16.5 | 10.3 | 7.88 | 7.9 | 80.2 | 80.1 | 7.0 | 7.4 | 9.2 | 9.2 | 9 | 8.0 |
| WM1 | 10:10 | 0.26 | 16.5 | 16.5 | 6.01 | 6.0 | 61.6 | 61.7 | 24.9 | 25.6 | 8.4 | 8.4 | 26 | 25.5 |
| W IVI I | 10.10 | 0.20 | 16.5 | 10.3 | 6.03 | 0.0 | 61.8 | 61.7 | 26.3 | 23.0 | 8.4 | 0.4 | 25 | 23.3 |



Water Quality Monitoring Data for Contract 2 and 3

| Date | 3-Jan-17 | | • | | = | - | • | = | • | • | | • | - | • |
|-------------|----------|-----------|------|------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | y (NTU) | p | H | SS(n | ng/L) |
| WM4-CA | 11:55 | 0.18 | 21.2 | 21.2 | 7.75 | 7.8 | 87.3 | 87.5 | 4.6 | 4.4 | 8.7 | 8.7 | 4 | 2.5 |
| WWI4-CA | 11.55 | 0.18 | 21.2 | 21.2 | 7.81 | 7.0 | 87.7 | 87.3 | 4.3 | 4.4 | 8.7 | 0.7 | 3 | 3.5 |
| WM4 CD | 12.05 | 0.21 | 22.7 | 22.7 | 5.81 | 5.0 | 67.5 | (0.1 | 9.3 | 0.4 | 8.2 | 0.2 | 10 | 0.5 |
| WM4-CB | 12:05 | 0.31 | 22.7 | 22.7 | 5.94 | 5.9 | 68.6 | 68.1 | 9.4 | 9.4 | 8.2 | 8.2 | 9 | 9.5 |
| XX 73. 4. 4 | 11 47 | 0.14 | 21.3 | 21.2 | 8.11 | 0.1 | 91.1 | 01.4 | 12.2 | 12.0 | 8.9 | 0.0 | 16 | 16.0 |
| WM4 | 11:45 | 0.14 | 21.3 | 21.3 | 8.15 | 8.1 | 91.7 | 91.4 | 13.3 | 12.8 | 8.9 | 8.9 | 16 | 16.0 |

| Date | 5-Jan-17 | | • | | _ | - | • | - | • | • | - | • | - | • |
|----------|----------|-----------|------|------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | р | H | SS(n | ng/L) |
| WM4-CA | 13:30 | 0.18 | 21.9 | 21.9 | 8.18 | 8.2 | 93.3 | 93.4 | 16.0 | 15.7 | 8.8 | 8.8 | 14 | 15.0 |
| WW4-CA | 13.30 | 0.18 | 21.9 | 21.9 | 8.2 | 0.2 | 93.5 | 93.4 | 15.3 | 13.7 | 8.8 | 0.0 | 16 | 13.0 |
| WM4-CB | 13:15 | 0.31 | 23.1 | 23.1 | 6.36 | 6.1 | 74.3 | 74.4 | 12.8 | 12.9 | 8.3 | 8.3 | 8 | 9.0 |
| WW4-CB | 13.13 | 0.51 | 23.1 | 23.1 | 6.38 | 6.4 | 74.4 | /4.4 | 13.0 | 12.9 | 8.3 | 6.3 | 10 | 9.0 |
| WM4 | 13:00 | 0.14 | 22.7 | 22.7 | 7.98 | 8.0 | 92.2 | 92.5 | 14.9 | 14.2 | 8.6 | 8.6 | 13 | 12.0 |
| vv 1V14 | 15.00 | 0.14 | 22.7 | 22.1 | 8 | 8.0 | 92.7 | 92.3 | 13.5 | 14.2 | 8.6 | 8.0 | 11 | 12.0 |

| Date | 7-Jan-17 | | | | | | | | | | | | | |
|----------|----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | ty (NTU) | p | H | SS(n | ng/L) |
| WM4-CA | 11:55 | 0.18 | 22.5 | 22.5 | 8.42 | 8.4 | 97.1 | 96.5 | 13.8 | 13.8 | 8.8 | 8.8 | 9 | 9.0 |
| WW4-CA | 11.55 | 0.18 | 22.5 | 22.3 | 8.46 | 0.4 | 95.8 | 90.3 | 13.7 | 13.6 | 8.8 | 0.0 | 9 | 9.0 |
| WM4-CB | 12:10 | 0.31 | 23.8 | 23.8 | 6.13 | 6.1 | 72.6 | 72.7 | 13.2 | 12.9 | 8.3 | 0.2 | 11 | 10.0 |
| WW4-CB | 12.10 | 0.31 | 23.8 | 23.8 | 6.14 | 6.1 | 72.7 | 12.1 | 12.5 | 12.9 | 8.3 | 8.3 | 9 | 10.0 |
| WM4 | 11:45 | 0.14 | 22.8 | 22.8 | 8.14 | 8.1 | 94.5 | 94.1 | 21.3 | 21.0 | 8.5 | 8.5 | 15 | 16.0 |
| W W14 | 11.43 | 0.14 | 22.8 | 22.8 | 8.13 | 0.1 | 93.7 | 94.1 | 20.6 | 21.0 | 8.5 | 8.3 | 17 | 10.0 |

| Date | 10-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|------------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(n | ng/L) |
| WM4-CA | 11:35 | 0.18 | 21 | 21.0 | 7.95 | 8.0 | 88.9 | 89.0 | over | 0110mom 00 | 8.6 | 0.6 | 715 | 690.5 |
| WW4-CA | 11.55 | 0.18 | 21 | 21.0 | 7.97 | 8.0 | 89.0 | 89.0 | range | overange | 8.6 | 8.6 | 666 | 090.3 |
| WM4-CB | 11:50 | 0.31 | 22.2 | 22.2 | 6.22 | 6.2 | 71.4 | 71.6 | 29.9 | 29.8 | 8.1 | 8.1 | 37 | 36.5 |
| WW4-CB | 11.30 | 0.51 | 22.2 | 22.2 | 6.25 | 0.2 | 71.7 | /1.6 | 29.7 | 29.8 | 8.1 | 0.1 | 36 | 30.3 |
| 3373.4.4 | 11.05 | 0.14 | 21.8 | 21.0 | 7.83 | 7.0 | 89.6 | 90.7 | 14.6 | 12.0 | 8.5 | 0.5 | 14 | 12.0 |
| WM4 | 11:25 | 0.14 | 21.8 | 21.8 | 7.85 | 7.8 | 89.8 | 89.7 | 13.1 | 13.9 | 8.5 | 8.5 | 12 | 13.0 |



| Date | 12-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | р | H | SS(n | ng/L) |
| WM4-CA | 11:35 | 0.18 | 19.5 | 19.5 | 7.73 | 7.7 | 84.4 | 84.5 | 210.0 | 215.0 | 9.3 | 9.3 | 159 | 158.5 |
| WW4-CA | 11.55 | 0.18 | 19.5 | 19.3 | 7.75 | 7.7 | 84.5 | 84.3 | 220.0 | 213.0 | 9.3 | 9.3 | 158 | 136.3 |
| WM4-CB | 11:45 | 0.31 | 20.2 | 20.2 | 4.46 | 4.4 | 48.9 | 48.6 | 26.0 | 25.1 | 8.8 | 8.8 | 15 | 14.5 |
| WW4-CD | 11.43 | 0.31 | 20.2 | 20.2 | 4.34 | 4.4 | 48.3 | 48.0 | 24.2 | 23.1 | 8.8 | 8.8 | 14 | 14.3 |
| 3373.4.4 | 11.05 | 0.14 | 19.8 | 10.0 | 7.03 | 7.0 | 76.8 | 77.0 | 18.2 | 17.7 | 9.3 | 0.2 | 18 | 17.0 |
| W W14 | WM4 11:25 | 0.14 | 19.8 | 19.8 | 7.05 | 7.0 | 77.5 | 77.2 | 17.1 | 17.7 | 9.3 | 9.3 | 16 | 17.0 |

| Date | 14-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (ı | mg/L) | DO | (%) | Turbidit | y (NTU) | р | Н | SS(n | ng/L) |
| WM4 CA | 11.57 | 0.17 | 16.9 | 16.0 | 8.42 | 0.5 | 86.6 | 97.0 | 38.4 | 39.6 | 8.3 | 0.2 | 86 | 99.0 |
| WM4-CA | 11:57 | 0.17 | 16.8 | 16.9 | 8.56 | 8.5 | 87.3 | 87.0 | 40.8 | 39.0 | 8.3 | 8.3 | 90 | 88.0 |
| WM4-CB | 12:08 | 0.30 | 17.3 | 17.3 | 6.4 | 6.4 | 66.6 | 67.2 | 10.6 | 10.9 | 7.9 | 7.9 | 7 | 7.5 |
| WIM4-CD | 12.08 | 0.30 | 17.3 | 17.3 | 6.49 | 6.4 | 67.8 | 07.2 | 11.1 | 10.9 | 7.9 | 7.9 | 8 | 7.3 |
| 3373.4.4 | 11.25 | 0.20 | 17 | 17.1 | 7.76 | 7.0 | 80.4 | 01.1 | 28.1 | 20.0 | 8.3 | 0.2 | 26 | 25.0 |
| WM4 | 11:35 | 0.29 | 17.2 | 17.1 | 7.83 | 7.8 | 81.7 | 81.1 | 29.5 | 28.8 | 8.3 | 8.3 | 24 | 25.0 |

| Date | 17-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|------------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | р | Н | SS(n | ng/L) |
| WM4-CA | 13:15 | 0.10 | 19.6 | 19.6 | 8.73 | 0.7 | 95.6 | 95.6 | 35.5 | 35.7 | 8.6 | 8.6 | 18 | 19.0 |
| WW4-CA | 13.13 | 0.18 | 19.6 | 19.0 | 8.71 | 8.7 | 95.5 | 93.0 | 35.9 | 33.7 | 8.6 | 8.0 | 20 | 19.0 |
| WMA CD | 12.25 | 0.21 | 20.5 | 20.5 | 6.05 | <i>(</i> 1 | 67.2 | (7.3 | 7.7 | 0.1 | 8.4 | 0.4 | 7 | (0 |
| WM4-CB | 13:25 | 0.31 | 20.5 | 20.5 | 6.05 | 6.1 | 67.2 | 67.2 | 8.4 | 8.1 | 8.4 | 8.4 | 5 | 6.0 |
| 3373.474 | 12.00 | 0.14 | 20.1 | 20.1 | 7.77 | 7.0 | 85.2 | 95.3 | 16.2 | 15.0 | 8.8 | 0.0 | 15 | 15.0 |
| W IVI4 | WM4 13:00 | 0.14 | 20.1 | 20.1 | 7.78 | 7.8 | 85.4 | 85.3 | 15.5 | 15.9 | 8.8 | 8.8 | 15 | 15.0 |



| Date | 19-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (r | ng/L) | DO | (%) | Turbidit | y (NTU) | p | H | SS(n | ng/L) |
| WM4-CA | 13:10 | 0.10 | 21 | 21.0 | 8.35 | 8.4 | 93.8 | 93.9 | 6.3 | 6.5 | 9.4 | 9.4 | 3 | 2.5 |
| WW4-CA | 15.10 | 0.18 | 21 | 21.0 | 8.36 | 0.4 | 93.9 | 93.9 | 6.6 | 6.5 | 9.4 | 9.4 | 2 | 2.3 |
| WM4 CD | 12.25 | 0.21 | 22.5 | 22.5 | 6 | (0 | 57.6 | 57.7 | 9.1 | 0.1 | 9.1 | 0.1 | 7 | 7.0 |
| WM4-CB | 13:25 | 0.31 | 22.5 | 22.5 | 6.02 | 6.0 | 57.8 | 57.7 | 9.2 | 9.1 | 9.1 | 9.1 | 7 | 7.0 |
| 3373.4.4 | 12.00 | 0.14 | 21 | 21.0 | 7.28 | 7.2 | 82.0 | 02.1 | 20.6 | 20.6 | 9.7 | 0.7 | 23 | 22.0 |
| WM4 | 13:00 | 0.14 | 21 | 21.0 | 7.29 | 7.3 | 82.1 | 82.1 | 20.5 | 20.6 | 9.7 | 9.7 | 21 | 22.0 |

| Date | 21-Jan-17 | | - | | _ | - | - | - | • | | | | - | - |
|-----------|------------|-----------|------|--------|-------|-------|-------|-------|----------|----------|-----|------|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p | Н | SS(r | ng/L) |
| WM4-CA | 11:49 | 0.20 | 19 | 19.2 | 9.19 | 9.2 | 99.6 | 99.8 | 6.7 | 6.8 | 9.8 | 9.8 | <2 | <2 |
| WWI4-CA | 11.47 | 0.20 | 19.3 | 19.2 | 9.23 | 9.2 | 99.9 | 77.0 | 6.8 | 0.6 | 9.8 | 7.0 | <2 | ~2 |
| WM4-CB | 12:07 | 0.38 | 20 | 20.1 | 6.65 | 6.7 | 72.9 | 73.5 | 12.7 | 12.8 | 9.2 | 9.2 | 9 | 10.0 |
| WWI4-CD | 12.07 | 0.56 | 20.1 | 20.1 | 6.7 | 0.7 | 74.1 | 73.3 | 12.9 | 12.0 | 9.2 | 7.2 | 11 | 10.0 |
| WM4 | 11:36 | 0.29 | 18.5 | 18.6 | 7.86 | 7.9 | 83.6 | 84.1 | 72.9 | 73.3 | 10 | 10.0 | 121 | 126.5 |
| VV 1V1-4 | 11.50 | 0.29 | 18.6 | 16.0 | 7.9 | 1.9 | 84.5 | 04.1 | 73.7 | 13.3 | 10 | 10.0 | 132 | 120.5 |
| Date | 23-Jan-17 | - | - | | | | | | - | | | | | |
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p | H | SS(r | ng/L) |
| WMA CA | 13:15 | 0.10 | 20.2 | 20.2 | 9.48 | 9.5 | 104.8 | 105.0 | 4.2 | 4.4 | 8.1 | 8.1 | <2 | <2 |
| WM4-CA | 13:13 | 0.18 | 20.2 | 20.2 | 9.54 | 9.3 | 105.1 | 105.0 | 4.6 | 4.4 | 8.1 | 8.1 | <2 | <2 |
| WM4-CB | 13:30 | 0.31 | 21.4 | 21.4 | 7.21 | 7.2 | 81.3 | 81.2 | 7.5 | 7.2 | 7.8 | 7.8 | 6 | 6.5 |
| WW4-CB | 13.30 | 0.51 | 21.4 | 21.4 | 7.16 | 1.2 | 81.0 | 01.2 | 7.0 | 1.2 | 7.8 | 7.0 | 7 | 0.5 |
| WM4 | 13:00 | 0.14 | 19.5 | 19.5 | 8.46 | 8.5 | 92.5 | 92.5 | 13.2 | 13.1 | 8.3 | 8.3 | 15 | 14.0 |
| W IVI4 | 13.00 | 0.14 | 19.5 | 19.3 | 8.49 | 6.3 | 92.4 | 92.3 | 12.9 | 13.1 | 8.3 | 0.3 | 13 | 14.0 |
| Date | 24-Jan-17# | - | · | | | - | - | - | - | - | | - | - | - |
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p | Н | SS(r | ng/L) |
| 11/1/4 CA | 12.40 | 0.10 | | | | | | | 2.2 | 2.6 | | | <2 | -2 |
| WM4-CA | 12:40 | 0.18 | | | | | | | 2.9 | 2.6 | | | | <2 |
| WMA CD | 12.50 | 0.21 | | | | | | | 5.1 | 5.2 | | | 7 | 7.0 |
| WM4-CB | 12:50 | 0.31 | | | | | | | 5.2 | 5.2 | | | | 7.0 |
| WM4 | 12.20 | 0.14 | | | | | | | 9.0 | 9.1 | | | 17 | 17.0 |
| W 1V14 | 12:30 | 0.14 | | | | | | | 9.3 | 9.1 | | | - | 17.0 |



| Date | 25-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|-------|-------|----------|---------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | р | Н | SS(n | ng/L) |
| WM4-CA | 13:10 | 0.18 | 21 | 21.0 | 10.15 | 10.2 | 113.8 | 113.9 | 5.2 | 5.2 | 9 | 9.0 | 2 | 2.0 |
| WW4-CA | 13.10 | 0.18 | 21 | 21.0 | 10.16 | 10.2 | 113.9 | 113.9 | 5.1 | 3.2 | 9 | 9.0 | 2 | 2.0 |
| WM4-CB | 13:20 | 0.31 | 21.5 | 21.5 | 6.21 | 6.2 | 70.3 | 70.4 | 10.0 | 9.8 | 8.5 | 8.5 | 8 | 8.0 |
| WW4-CD | 13.20 | 0.31 | 21.5 | 21.5 | 6.23 | 0.2 | 70.5 | /0.4 | 9.7 | 9.8 | 8.5 | 8.3 | 8 | 8.0 |
| 3373.4.4 | 12.00 | 0.14 | 19.5 | 10.5 | 8.2 | 0.2 | 89.7 | 90.9 | 22.9 | 22.0 | 9 | 0.0 | 21 | 20.5 |
| VV 1V14 | WM4 13:00 | 0.14 | 19.5 | 19.5 | 8.21 | 8.2 | 89.8 | 89.8 | 22.7 | 22.8 | 9 | 9.0 | 20 | 20.5 |

| Date | 27-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|-------|-------|----------|---------|-----|-----|------|---------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ng/L) |
| WM4-CA | 13:10 | 0.10 | 19.5 | 19.5 | 9.97 | 10.0 | 109.5 | 110.4 | 4.6 | 4.4 | 9.3 | 9.3 | 4 | 2.0 |
| WW4-CA | 13.10 | 0.18 | 19.5 | 19.3 | 10.1 | 10.0 | 111.2 | 110.4 | 4.2 | 4.4 | 9.3 | 9.3 | 2 | 3.0 |
| WM4-CB | 13:20 | 0.21 | 20.5 | 20.5 | 6.12 | 6.1 | 68.2 | 68.3 | 7.5 | 7.7 | 8.7 | 9.7 | 8 | 7.5 |
| WW4-CD | 13.20 | 0.31 | 20.5 | 20.3 | 6.13 | 6.1 | 68.3 | 08.3 | 7.8 | 7.7 | 8.7 | 8.7 | 7 | 7.5 |
| 3373.4.4 | 12.00 | 0.14 | 18.5 | 10.5 | 8.03 | 0.1 | 85.5 | 96.0 | 6.4 | 6.4 | 9.4 | 0.4 | 5 | <i></i> |
| WM4 | 13:00 | 0.14 | 18.5 | 18.5 | 8.09 | 8.1 | 86.5 | 86.0 | 6.4 | 6.4 | 9.4 | 9.4 | 6 | 5.5 |

Remarks:

Additional water quality monitoring for the parameters with Action/Limit Level exceedance triggered only.

| Action Level |
|---------------------|
| Limit Level |



Water Quality Monitoring Data for Contract 6

| Date | 3-Jan-17 | • | - | | = | | - | | • | • | - | - | | , |
|-----------|----------|-----------|--------------|-----------|------|-------|--------------|------|----------|---------|--------------|-----|------|-------|
| Location | Time | Depth (m) | Temp | Temp (oC) | | ng/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ıg/L) |
| WM2A-C | 10:40 | 0.28 | 19.2 | 19.2 | 8.02 | 8.0 | 86.7 | 87.0 | 8.3 | 8.4 | 7.80 | 7.8 | 4 | 1.5 |
| WWZA-C | 10.40 | 0.28 | 19.2 | 19.2 | 8.06 | 8.0 | 87.3 | 87.0 | 8.5 | 0.4 | 7.80 | 7.8 | 5 | 4.5 |
| 3373 42 A | 10.25 | 0.17 | 19.7 | 10.7 | 8.18 | 0.7 | 89.3 | 00.2 | 15.3 | 15.4 | 8.10 | 0.1 | 12 | 12.5 |
| WM2A | 10:25 | 0.17 | 19.7 | 19.7 | 8.17 | 8.2 | 89.3 | 89.3 | 15.4 | 15.4 | 8.10 | 8.1 | 13 | 12.5 |

| Date | 5-Jan-17 | | | | | | | | | | | | | |
|----------|----------|-----------|------|------|-------|-------|------|------|----------|---------|------|-----|------|------------|
| Location | Time | Depth (m) | Temp | (oC) | DO (r | ng/L) | DO | (%) | Turbidit | y (NTU) | р | Н | SS(m | ng/L) |
| WM2A-C | 10:35 | 0.28 | 19.7 | 19.7 | 7.72 | 7.7 | 84.2 | 84.3 | 12.1 | 12.0 | 8.60 | 8.6 | <2 | <2 |
| W WIZA-C | 10.55 | 0.28 | 19.7 | 19.7 | 7.74 | 7.7 | 84.4 | 04.3 | 11.8 | 12.0 | 8.60 | 0.0 | <2 | \ <u>Z</u> |
| WM2A | 10:25 | 0.17 | 20.5 | 20.5 | 7.73 | 7.7 | 85.9 | 86.0 | 18.9 | 19.0 | 8.80 | 8.8 | 14 | 14.5 |
| W WIZA | 10.23 | 0.17 | 20.5 | 20.5 | 7.75 | 1.1 | 86.1 | 80.0 | 19.1 | 19.0 | 8.80 | 8.8 | 15 | 14.3 |

| Date | 7-Jan-17 | | - | | _ | • | - | - | • | • | - | - | - | • |
|-----------|----------|-----------|------|------|-------|-------|--------------|------|----------|---------|------|--------------|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ng/L) |
| WM2A-C | 10:35 | 0.28 | 20.2 | 20.2 | 7.65 | 77 | 84.4 | 84.3 | 9.6 | 9.4 | 8.00 | 8.0 | <2 | /2 |
| W WIZA-C | 10.55 | 0.28 | 20.2 | 20.2 | 7.68 | 7.7 | 84.2 | 04.3 | 9.1 | 9.4 | 8.00 | 8.0 | <2 | <2 |
| 11/1 A2 A | 10.20 | 0.17 | 20.9 | 20.0 | 7.95 | 7.0 | 89.0 | 00.4 | 8.6 | 0.5 | 7.80 | 7.0 | 4 | 4.0 |
| WM2A | 10:20 | 0.17 | 20.9 | 20.9 | 7.89 | 7.9 | 87.7 | 88.4 | 8.3 | 8.5 | 7.80 | 7.8 | 4 | 4.0 |

| Date | 10-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|-------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(m | ng/L) |
| WMAA C | 10.20 | 0.20 | 19.9 | 19.9 | 7.82 | 7.0 | 85.8 | 86.0 | 15.2 | 1.5.1 | 8.10 | 0.1 | 4 | 2.0 |
| WM2A-C | 10:30 | 0.28 | 19.9 | 19.9 | 7.86 | 7.8 | 86.1 | 80.0 | 14.9 | 13.1 | 8.10 | 8.1 | 2 | 3.0 |
| WM2A | 10.20 | 0.17 | 20.6 | 20.6 | 7.55 | 7.6 | 84.0 | 0.4.1 | 21.9 | 21.6 | 8.40 | 0.4 | 14 | 140 |
| W WIZA | 10:20 | 0.17 | 20.6 | 20.0 | 7.58 | 7.6 | 84.2 | 84.1 | 21.2 | 21.6 | 8.40 | 8.4 | 14 | 14.0 |

| Date | 12-Jan-17 | • | | | | - | | | | • | | - | | |
|-----------|-----------|-----------|------|--------|-------|-------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | y (NTU) | р | Н | SS(m | ng/L) |
| WM2A-C | 10:35 | 0.28 | 19.2 | 19.2 | 7.41 | 7.4 | 80.7 | 80.8 | 9.8 | 9.9 | 7.80 | 7.8 | 3 | 3.0 |
| W WIZA-C | 10.55 | 0.28 | 19.2 | 19.2 | 7.43 | 7.4 | 80.8 | 80.8 | 10.0 | 9.9 | 7.80 | 7.8 | 3 | 3.0 |
| 3373 42 A | 10.25 | 0.17 | 19.8 | 10.0 | 7.54 | 7.6 | 82.9 | 02.0 | 12.0 | 11.0 | 8.30 | 0.2 | 6 | 7.0 |
| WM2A | 10:25 | 0.17 | 19.8 | 19.8 | 7.56 | 7.6 | 83.1 | 83.0 | 11.7 | 11.9 | 8.30 | 8.3 | 8 | 7.0 |



| Date | 14-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ng/L) |
| WM2A-C | 9:47 | 0.38 | 17 | 17.0 | 8.41 | 8.5 | 86.9 | 87.4 | 10.2 | 10.6 | 8.70 | 8.7 | 2 | 2.0 |
| WWZA-C | 9.47 | 0.38 | 17 | 17.0 | 8.5 | 8.5 | 87.9 | 87.4 | 11.0 | 10.6 | 8.70 | 8.7 | 2 | 2.0 |
| WM2A | 10.00 | 0.17 | 16.4 | 16.4 | 8.21 | 0.2 | 84.3 | 05.0 | 7.8 | 7.0 | 9.00 | 0.0 | 7 | 7.0 |
| W WIZA | 10:00 | 0.17 | 16.4 | 16.4 | 8.27 | 8.2 | 85.7 | 85.0 | 8.0 | 7.9 | 9.00 | 9.0 | 7 | 7.0 |

| Date | 17-Jan-17 | • | | | | - | - | | | | | - | | • |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | р | Н | SS(n | ng/L) |
| WM2A-C | 10.25 | 0.29 | 18 | 10.0 | 8.19 | 0.2 | 86.6 | 967 | 15.4 | 15.5 | 7.60 | 7.6 | 4 | 4.0 |
| WMZA-C | 10:35 | 0.28 | 18 | 18.0 | 8.21 | 8.2 | 86.7 | 86.7 | 15.5 | 15.5 | 7.60 | 7.6 | 4 | 4.0 |
| WM2A | 10.25 | 0.17 | 18 | 10.0 | 8.3 | 0.2 | 88.1 | 88.2 | 9.6 | 0.7 | 7.70 | 7.7 | 6 | 6.0 |
| W WIZA | 10:25 | 0.17 | 18 | 18.0 | 8.32 | 8.3 | 88.2 | 86.2 | 9.8 | 9.7 | 7.70 | 1.7 | 6 | 6.0 |

| Date | 19-Jan-17 | | | | | | - | - | | | | - | | |
|-----------|-----------|-----------|------|-------|-------|-------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | o(oC) | DO (r | ng/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ng/L) |
| WM2A-C | 10:45 | 0.28 | 19.5 | 19.5 | 7.75 | 7.8 | 84.9 | 85.3 | 13.8 | 13.6 | 7.90 | 7.9 | 4 | 4.0 |
| WWZA-C | 10.43 | 0.28 | 19.5 | 19.3 | 7.84 | 7.8 | 85.6 | 83.3 | 13.4 | 13.0 | 7.90 | 7.9 | 4 | 4.0 |
| 3373 42 A | 10.20 | 0.17 | 20.2 | 20.2 | 7.91 | 7.0 | 87.5 | 07.7 | 12.9 | 12.0 | 7.80 | 7.0 | 11 | 10.0 |
| WM2A | 10:30 | 0.17 | 20.2 | 20.2 | 7.95 | 7.9 | 87.8 | 87.7 | 12.7 | 12.8 | 7.80 | 7.8 | 9 | 10.0 |

| Date | 21-Jan-17 | | | | | - | | | • | | - | - | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(m | ng/L) |
| WM2A-C | 10:01 | 0.34 | 16.5 | 16.5 | 8.15 | 0.2 | 83.9 | 84.3 | 11.8 | 11.9 | 8.10 | 8.1 | <2 | |
| WWZA-C | 10.01 | 0.34 | 16.5 | 10.3 | 8.2 | 8.2 | 84.7 | 84.3 | 11.9 | 11.9 | 8.10 | 0.1 | <2 | <2 |
| WM2A | 0.49 | 0.17 | 17.5 | 17.5 | 8.26 | 0.2 | 86.3 | 96.0 | 11.6 | 11.7 | 8.50 | 0.5 | 14 | 14.5 |
| W WIZA | 9:48 | 0.17 | 17.4 | 17.5 | 8.31 | 8.3 | 87.5 | 86.9 | 11.8 | 11.7 | 8.50 | 8.5 | 15 | 14.5 |



| Date | 23-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ng/L) |
| WM2A-C | 10:35 | 0.28 | 16.2 | 16.2 | 8.97 | 9.0 | 91.0 | 90.9 | 10.9 | 10.8 | 7.80 | 7.8 | <2 | /2 |
| W WIZA-C | 10.55 | 0.28 | 16.2 | 10.2 | 8.91 | 8.9 | 90.7 | 90.9 | 10.7 | 10.8 | 7.80 | 7.8 | <2 | <2 |
| WM2A | 10:25 | 0.17 | 16.6 | 16.6 | 9.03 | 9.0 | 92.6 | 92.6 | 12.9 | 12.7 | 7.90 | 7.9 | 12 | 12.0 |
| W WIZA | 10.23 | 0.17 | 16.6 | 10.0 | 9.03 | 9.0 | 92.5 | 92.0 | 12.4 | 12.7 | 7.90 | 7.9 | 12 | 12.0 |

| Date | 25-Jan-17 | • | | | | - | - | | | | - | - | | |
|-----------|-----------|-----------|------|-------|-------|-------|------|-------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | o(oC) | DO (1 | ng/L) | DO | (%) | Turbidit | y (NTU) | p. | Н | SS(n | ng/L) |
| WM2A-C | 10.25 | 0.20 | 17.5 | 17.5 | 7.93 | 7.9 | 82.8 | 82.9 | 12.1 | 10.2 | 8.70 | 0.7 | 2 | 2.0 |
| WM2A-C | 10:35 | 0.28 | 17.5 | 17.5 | 7.95 | 7.9 | 83.0 | 82.9 | 12.4 | 12.3 | 8.70 | 8.7 | 2 | 2.0 |
| 11/N 42 A | 10.25 | 0.17 | 18 | 10.0 | 8.02 | 9.0 | 85.0 | 0.5.1 | 21.6 | 21.6 | 9.00 | 0.0 | 14 | 140 |
| WM2A | 10:25 | 0.17 | 18 | 18.0 | 8.03 | 8.0 | 85.1 | 85.1 | 21.5 | 21.6 | 9.00 | 9.0 | 14 | 14.0 |

| Date | 27-Jan-17 | • | | | | - | - | | - | - | - | - | | |
|----------|-----------|-----------|------|------|-------|--------------|------|------|----------|---------|------|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | y (NTU) | p | Н | SS(n | ng/L) |
| WM2A-C | 10:35 | 0.28 | 16.5 | 16.5 | 7.8 | 7.8 | 80.6 | 81.1 | 12.4 | 12.2 | 8.20 | 8.2 | <2 | -2 |
| W WIZA-C | 10.55 | 0.28 | 16.5 | 16.5 | 7.86 | 7.8 | 81.6 | 81.1 | 12.2 | 12.3 | 8.20 | 0.2 | <2 | <2 |
| WM2A | 10.25 | 0.17 | 17.5 | 175 | 8.13 | 0.1 | 85.4 | 05.5 | 9.3 | 0.2 | 8.60 | 0.6 | 8 | 7.5 |
| W WIZA | 10:25 | 0.17 | 17.5 | 17.3 | 8.14 | 8.1 | 85.5 | 85.5 | 9.3 | 9.3 | 8.60 | 8.6 | 7 | 7.5 |



| Date | 5-Jan-17 | | | | | | | | | | | | | |
|----------|----------|-----------|------|--------|-------|-------|------|------|---------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | ng/L) | DO | (%) | Turbidi | ty (NTU) | p | H | SS(n | ng/L) |
| WWA2D C | 10.55 | 0.02 | 22.4 | 22.4 | 6.77 | (0 | 78.1 | 70.0 | 4.9 | 5.1 | 8.9 | 0.0 | <2 | -2 |
| WM2B-C | 10:55 | 0.02 | 22.4 | 22.4 | 6.76 | 6.8 | 77.8 | 78.0 | 5.3 | 3.1 | 8.9 | 8.9 | <2 | <2 |
| WW 42D | 10.40 | 0.02 | 21.1 | 21.1 | 8.35 | 0.4 | 93.5 | 02.0 | 8.9 | 0.4 | 8.8 | 0.0 | 7 | 7.0 |
| WM2B | 10:40 | 0.02 | 21.1 | 21.1 | 8.39 | 8.4 | 94.3 | 93.9 | 7.9 | 8.4 | 8.8 | 8.8 | 7 | 7.0 |

| Date | 7-Jan-17 | | | | | | | · | | | · | | · | - |
|----------|-----------|-----------|------|------|-------|-------|-------|-------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (r | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(n | ng/L) |
| WM2D C | 11.00 | 0.02 | 22.4 | 22.4 | 7.19 | 7.0 | 82.8 | 92.6 | 3.0 | 2.0 | 8.4 | 0.4 | 3 | 2.5 |
| WM2B-C | 11:00 | 0.02 | 22.4 | 22.4 | 7.17 | 7.2 | 82.3 | 82.6 | 2.9 | 3.0 | 8.4 | 8.4 | 2 | 2.5 |
| WM2B | 10.50 | 0.02 | 21.3 | 21.2 | 8.68 | 0.7 | 97.9 | 07.2 | 3.7 | 2.6 | 7.9 | 7.0 | 3 | 2.0 |
| W MZB | 10:50 | 0.02 | 21.3 | 21.3 | 8.65 | 8.7 | 96.5 | 97.2 | 3.5 | 3.6 | 7.9 | 7.9 | 3 | 3.0 |
| Date | 10-Jan-17 | | | | | | | | | | | | | |
| Location | Time | Depth (m) | Temp | (oC) | DO (r | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(n | ng/L) |
| WM2D C | 10.55 | 0.02 | 22.2 | 22.2 | 7.23 | 7.0 | 83.1 | 02.2 | 4.1 | 4.0 | 8.3 | 0.2 | <2 | -2 |
| WM2B-C | 10:55 | 0.02 | 22.2 | 22.2 | 7.25 | 7.2 | 83.5 | 83.3 | 3.9 | 4.0 | 8.3 | 8.3 | <2 | <2 |
| WMAD | 10.45 | 0.02 | 20.8 | 20.9 | 8.95 | 0.0 | 100.3 | 100.4 | 7.3 | 7.0 | 7.9 | 7.0 | 3 | 2.5 |
| WM2B | 10:45 | 0.02 | 20.8 | 20.8 | 8.97 | 9.0 | 100.4 | 100.4 | 7.1 | 7.2 | 7.9 | 7.9 | 2 | 2.5 |

| Date | 12-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p. | H | SS(n | ıg/L) |
| WM2B-C | 10.55 | 0.02 | 21.8 | 21.0 | 7.14 | 7.2 | 81.9 | 02.1 | 3.9 | 2.6 | 7.9 | 7.9 | <2 | -2 |
| WM2B-C | 10:55 | 0.02 | 21.8 | 21.8 | 7.18 | 1.2 | 82.2 | 82.1 | 3.4 | 3.6 | 7.9 | 7.9 | <2 | <2 |
| WM2B | 10.45 | 0.02 | 19.6 | 10.6 | 8.74 | 0 0 | 95.4 | 05.6 | 8.5 | 0.0 | 7.8 | 7.8 | 10 | 10.0 |
| WMZB | 10:45 | 0.02 | 19.6 | 19.6 | 8.77 | 8.8 | 95.7 | 95.6 | 9.1 | 8.8 | 7.8 | 7.8 | 10 | 10.0 |

| Date | 14-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p | H | SS(n | ng/L) |
| WWW2D C | 10.24 | 0.02 | 17.3 | 17.2 | 7.45 | 7.5 | 84.5 | 05.3 | 2.9 | 2.0 | 8.4 | 0.4 | <2 | -2 |
| WM2B-C | 10:34 | 0.02 | 17.3 | 17.3 | 7.53 | 7.5 | 85.9 | 85.2 | 3.0 | 3.0 | 8.4 | 8.4 | <2 | <2 |
| WW 42D | 10.10 | 0.02 | 17.1 | 17.1 | 9.15 | 9.2 | 95.1 | 05.7 | 6.7 | (0 | 8.4 | 0.4 | 4 | 2.5 |
| WM2B | 10:19 | 0.02 | 17.1 | 1/.1 | 9.2 | 9.2 | 96.2 | 95.7 | 6.8 | 6.8 | 8.4 | 8.4 | 3 | 3.3 |



| Time | Depth (m) | Temp | o (oC) | DO (r | ng/L) | DO | (%) | Turbidi | ty (NTU) | р | Н | SS(m | ng/L) |
|-----------|---|-------|--------|-------|-------|--|-------|---------|------------|-------|-------|-------|-------|
| 10.55 | 0.02 | 22 | 22.0 | 7.34 | 7.4 | 83.8 | 92.0 | 3.5 | 2.2 | 9.4 | 0.4 | <2 | <2 |
| 10:55 | 0.02 | 22 | 22.0 | 7.37 | 7.4 | 83.9 | 83.9 | 3.2 | 3.3 | 9.4 | 9.4 | <2 | <2 |
| 10.45 | 0.02 | 18.8 | 10 0 | 8.62 | 0.6 | 92.2 | 02.2 | 7.4 | 7.4 | 9.5 | 0.5 | 10 | 9.5 |
| 10.43 | 0.02 | 18.8 | 16.6 | 8.61 | 8.0 | 92.3 | 92.3 | 7.4 | 7.4 | 9.5 | 9.3 | 9 | 9.3 |
| 19-Jan-17 | | | | - | - | - | | - | | | - | | |
| Time | Depth (m) | Temp | o (oC) | DO (r | ng/L) | DO | (%) | Turbidi | ty (NTU) | р | Н | SS(m | ng/L) |
| 11.10 | 0.02 | 22 | 22.0 | 6.37 | 6.4 | 73.3 | 72.4 | 4.8 | 4.0 | 9.5 | 0.5 | <2 | -2 |
| 11:10 | 0.02 | 22 | 22.0 | 6.38 | 6.4 | 73.5 | /3.4 | 4.9 | 4.8 | 9.5 | 9.5 | <2 | <2 |
| 11:00 | 0.02 | 21 | 21.0 | 7.62 | 7.6 | 86.0 | 86.1 | 11.2 | 11.3 | 10.4 | 10.4 | 10 | 10.5 |
| 11.00 | 0.02 | 21 | 21.0 | 7.63 | 7.0 | 86.1 | 80.1 | 11.4 | 11.5 | 10.4 | 10.4 | 11 | 10.5 |
| 21-Jan-17 | | | | | | , | | _ | | | | | |
| Time | Depth (m) | Temp | o (oC) | DO (r | ng/L) | DO | (%) | Turbidi | ty (NTU) | p | Н | SS(m | ng/L) |
| 10.25 | 0.02 | 21 | 21.1 | 7.43 | 7.5 | 84.3 | 05.1 | 6.1 | <i>C</i> 1 | 9.9 | 0.0 | <2 | -2 |
| 10:35 | 0.02 | 21.1 | 21.1 | 7.5 | 7.5 | 85.8 | 85.1 | 6.2 | 6.1 | 9.9 | 9.9 | <2 | <2 |
| 10.10 | 0.02 | 175 | 17.5 | 8.47 | 0.5 | 88.5 | 80.0 | 7.2 | 7.2 | 10.3 | 10.3 | 3 | 3.5 |
| 10.19 | 0.02 | 17.5 | 17.3 | 8.53 | 0.5 | 89.4 | 89.0 | 7.2 | 1.2 | 10.3 | 10.5 | 4 | 3.3 |
| 23-Jan-17 | | | | T | | | | _ | | | | | |
| Time | Depth (m) | Temp | o (oC) | DO (r | ng/L) | DO | (%) | Turbidi | ty (NTU) | p | Н | SS(m | ng/L) |
| 10.55 | 0.02 | 21 | 21.0 | 7.6 | 7.6 | 85.5 | 85.6 | 3.4 | 3.4 | 9.4 | 9 4 | <2 | <2 |
| 10.55 | 0.02 | | 21.0 | | 7.0 | | 05.0 | | 5.7 | | 7.1 | | -2 |
| 10:45 | 0.02 | | 16.8 | | 9.1 | | 93.3 | - | 7.6 | | 9.7 | | 11.5 |
| | 10:55 10:45 19-Jan-17 Time 11:10 11:00 21-Jan-17 Time 10:35 10:19 23-Jan-17 | 10:55 | 10:55 | 10:55 | 10:55 | $ \begin{array}{c ccccccccccccccccccccccccccccccccccc$ | 10:55 | 10:55 | 10:55 | 10:55 | 10:55 | 10:55 | 10:55 |



| Date | 25-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|------|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | ty (NTU) | p | Н | SS(n | ng/L) |
| WWAD C | 10.55 | 0.02 | 21.5 | 21.5 | 7.53 | 7.5 | 85.4 | 05.5 | 2.4 | 2.4 | 9.4 | 0.4 | <2 | -2 |
| WM2B-C | 10:55 | 0.02 | 21.5 | 21.5 | 7.55 | 7.5 | 85.6 | 85.5 | 2.3 | 2.4 | 9.4 | 9.4 | <2 | <2 |
| WM2B | 10:45 | 0.02 | 19 | 19.0 | 8.21 | 8.2 | 88.6 | 88.7 | 5.0 | 4.9 | 11 | 11.0 | 7 | 8.0 |
| WWZB | 10.45 | 0.02 | 19 | 19.0 | 8.23 | 8.2 | 88.8 | 00.7 | 4.8 | 4.9 | 11 | 11.0 | 9 | 8.0 |

| Date | 27-Jan-17 | - | | | | | - | | - | | | - | | - |
|----------|-----------|-----------|------|--------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | o (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | ty (NTU) | p | Н | SS(n | ng/L) |
| WWAD C | 10.55 | 0.02 | 20.5 | 20.5 | 7.45 | 7.5 | 83.7 | 94.6 | 2.9 | 2.0 | 8.4 | 0.4 | <2 | -2 |
| WM2B-C | 10:55 | 0.02 | 20.5 | 20.5 | 7.58 | 7.5 | 85.5 | 84.6 | 2.7 | 2.8 | 8.4 | 8.4 | <2 | <2 |
| WM2B | 10.45 | 0.02 | 17 | 17.0 | 8.77 | 0.0 | 91.2 | 01.2 | 4.0 | 2.0 | 8.1 | 0.1 | 3 | 2.5 |
| W WIZB | 10:45 | 0.02 | 17 | 17.0 | 8.78 | 8.8 | 91.3 | 91.3 | 3.7 | 3.8 | 8.1 | 8.1 | 4 | 3.5 |



Water Quality Monitoring Data for Contract 2 and 6

| Date | 3-Jan-17 | | | | _ | • | • | | | • | | • | • | |
|----------|----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | р | Н | SS(n | ng/L) |
| WW. C | 11.25 | 0.02 | 22.9 | 22.0 | 6.98 | 7.0 | 81.0 | 01.4 | 5.6 | 5.3 | 9.2 | 9.2 | 29 | 20.0 |
| WM3-C | 11:25 | 0.03 | 22.9 | 22.9 | 7.01 | 7.0 | 81.8 | 81.4 | 4.9 | 3.3 | 9.2 | 9.2 | 29 | 29.0 |
| WM3 | 11:15 | 0.15 | 20.6 | 20.6 | 7.34 | 7.4 | 81.7 | 45.0 | 7.2 | 7.1 | 9.2 | 9.2 | 13 | 12.5 |
| VV IVIS | 11.13 | 0.13 | 20.6 | 20.0 | 7.37 | 7.4 | 8.2 | 43.0 | 7.0 | 7.1 | 9.2 | 9.2 | 12 | 12.3 |

| Date | 5-Jan-17 | | | | | - | ٠ | - | - | • | - | • | - | |
|----------|----------|-----------|------|------|-------|-------|------|------|---------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidi | ty (NTU) | р | Н | SS(n | ng/L) |
| WM2 C | 11.10 | 0.02 | 23.5 | 22.5 | 6.64 | ((| 78.2 | 70.2 | 8.3 | 7.0 | 8.4 | 0.4 | <2 | -2 |
| WM3-C | 11:10 | 0.03 | 23.5 | 23.5 | 6.64 | 6.6 | 78.1 | 78.2 | 7.6 | 7.9 | 8.4 | 8.4 | <2 | <2 |
| WM3 | 11:25 | 0.15 | 21.2 | 21.2 | 7.42 | 7.4 | 83.3 | 83.4 | 9.8 | 9.4 | 8.8 | 8.8 | 3 | 3.5 |
| VV 1V13 | 11.23 | 0.13 | 21.2 | 21.2 | 7.41 | 7.4 | 83.4 | 63.4 | 9.1 | 9.4 | 8.8 | 0.0 | 4 | 3.3 |

| Date | 7-Jan-17 | • | | | _ | _ | • | - | • | • | | • | • | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p | H | SS(n | ng/L) |
| WM2 C | 11.15 | 0.02 | 24.7 | 24.7 | 7.49 | 7.5 | 90.1 | 90.9 | 4.5 | 4.6 | 8 | 8.0 | <2 | -2 |
| WM3-C | 11:15 | 0.03 | 24.7 | 24.7 | 7.46 | 7.5 | 89.5 | 89.8 | 4.8 | 4.6 | 8 | 8.0 | <2 | <2 |
| WM3 | 11:25 | 0.15 | 21.9 | 21.9 | 7.17 | 7.2 | 81.8 | 82.4 | 5.3 | 5.1 | 8.6 | 8.6 | 2 | 2.5 |
| W 1V13 | 11.23 | 0.15 | 21.9 | 21.9 | 7.23 | 1.2 | 83.0 | 62.4 | 5.0 | 3.1 | 8.6 | 8.0 | 3 | 2.3 |
| Date | 10-Jan-17 | | | | | | | | | | | | | |
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | р | H | SS(n | ng/L) |
| WM3-C | 11:05 | 0.03 | 23.1 | 23.1 | 7.01 | 7.0 | 81.8 | 81.9 | 6.3 | 6.0 | 7.5 | 7.5 | 8 | 9.0 |
| W W13-C | 11.03 | 0.03 | 23.1 | 23.1 | 7.03 | 7.0 | 82.0 | 81.9 | 5.8 | 0.0 | 7.5 | 7.3 | 10 | 9.0 |
| WM3 | 11:15 | 0.15 | 21 | 21.0 | 8.12 | 8.1 | 90.7 | 90.8 | 5.3 | 5.0 | 8.1 | 8.1 | 3 | 3.5 |
| VV 1V13 | 11.13 | 0.13 | 21 | 21.0 | 8.14 | 0.1 | 90.9 | 90.8 | 4.6 | 5.0 | 8.1 | 0.1 | 4 | 3.3 |

| Date | 12-Jan-17 | | | | | - | • | | • | • | | • | - | • |
|----------|-----------|-----------|------|------|-------|-------|------|------|---------|----------|-----|------|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidi | ty (NTU) | р | H | SS(n | ng/L) |
| WM2 C | 11:00 | 0.02 | 21.6 | 21.6 | 7.03 | 7.0 | 79.9 | 80.0 | 3.0 | 2.0 | 10 | 10.0 | <2 | \2 |
| WM3-C | 11:00 | 0.03 | 21.6 | 21.6 | 7.05 | 7.0 | 80.1 | 80.0 | 2.6 | 2.8 | 10 | 10.0 | <2 | <2 |
| 11/1/12 | 11.10 | 0.15 | 19.9 | 10.0 | 7.45 | 7.5 | 81.6 | 01.7 | 10.9 | 10.7 | 9.9 | 0.0 | 4 | 4.0 |
| WM3 | 11:10 | 0.15 | 19.9 | 19.9 | 7.45 | 7.5 | 81.8 | 81.7 | 10.5 | 10.7 | 9.9 | 9.9 | 4 | 4.0 |



| Date | 14-Jan-17 | • | | | | • | | | | • | | • | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | р | Н | SS(n | ng/L) |
| WM2 C | 10.40 | 0.25 | 20.2 | 20.2 | 7.9 | 7.0 | 87.1 | 97.6 | 2.5 | 2.6 | 7.8 | 7.0 | 3 | 2.0 |
| WM3-C | 10:49 | 0.35 | 20.2 | 20.2 | 7.95 | 7.9 | 88.1 | 87.6 | 2.6 | 2.6 | 7.8 | 7.8 | 3 | 3.0 |
| WM3 | 11:00 | 0.17 | 18.3 | 18.4 | 8.61 | 8.7 | 91.3 | 86.9 | 12.7 | 12.9 | 8.6 | 8.6 | 10 | 11.0 |
| W W15 | 11.00 | 0.17 | 18.4 | 16.4 | 8.7 | 0.7 | 82.5 | 80.9 | 13.1 | 12.9 | 8.6 | 8.0 | 12 | 11.0 |

| Date | 17-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|------|------|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p | Н | SS(n | ng/L) |
| WM3-C | 11:10 | 0.03 | 22.4 | 22.4 | 6.85 | 6.9 | 79.1 | 79.2 | 3.3 | 3.3 | 8.9 | 9.0 | 6 | 5.0 |
| W W13-C | 11.10 | 0.03 | 22.4 | 22.4 | 6.86 | 0.9 | 79.3 | 19.2 | 3.4 | 3.3 | 9 | 9.0 | 4 | 3.0 |
| WM3 | 11:25 | 0.15 | 19.9 | 19.9 | 7.63 | 7.6 | 83.6 | 83.7 | 4.5 | 4.4 | 9.3 | 9.3 | 4 | 4.0 |
| W WIS | 11.23 | 0.13 | 19.9 | 19.9 | 7.64 | 7.0 | 83.8 | 83.7 | 4.3 | 4.4 | 9.3 | 9.3 | 4 | 4.0 |
| Date | 19-Jan-17 | | | _ | | | | | | | | | | |
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | mg/L) | DO | (%) | Turbidit | ty (NTU) | p. | Н | SS(n | ng/L) |
| WM3-C | 11:20 | 0.03 | 23.5 | 23.5 | 6.99 | 7.0 | 83.0 | 83.2 | 1.9 | 1.8 | 10.8 | 10.8 | <2 | <2 |
| W W13-C | 11.20 | 0.03 | 23.5 | 23.3 | 7.05 | 7.0 | 83.4 | 83.2 | 1.6 | 1.0 | 10.8 | 10.8 | <2 | ~2 |
| WM3 | 11:35 | 0.15 | 21.5 | 21.5 | 7.1 | 7.1 | 80.6 | 80.7 | 7.9 | 7.5 | 10.7 | 10.7 | 8 | 9.0 |
| W 1V13 | 11.55 | 0.13 | 21.5 | 21.3 | 7.11 | 7.1 | 80.7 | 80.7 | 7.1 | 1.3 | 10.7 | 10.7 | 10 | 9.0 |

| Date | 21-Jan-17 | • | | | - | - | • | - | - | | | • | - | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|---------|------|------|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | y (NTU) | p | H | SS(m | ng/L) |
| WM3-C | 10:49 | 0.26 | 20.5 | 20.5 | 6.82 | 6.9 | 75.9 | 76.4 | 5.5 | 5.6 | 10 | 10.0 | 4 | 3.5 |
| W WIS-C | 10.49 | 0.20 | 20.5 | 20.3 | 6.93 | 0.9 | 76.8 | 70.4 | 5.6 | 3.0 | 10 | 10.0 | 3 | 3.3 |
| WM3 | 11:08 | 0.17 | 18.5 | 18.3 | 7.96 | 8.0 | 85.0 | 85.5 | 12.7 | 13.0 | 9.9 | 9.9 | 12 | 12.0 |
| W IVI3 | 11.08 | 0.17 | 18.1 | 16.3 | 7.99 | 8.0 | 85.9 | 83.3 | 13.3 | 13.0 | 9.9 | 9.9 | 12 | 12.0 |
| Date | 23-Jan-17 | | | | | | = | | | | | | | |
| Location | Time | Depth (m) | Temp | (oC) | DO (1 | ng/L) | DO | (%) | Turbidit | y (NTU) | p | H | SS(m | ng/L) |
| WM3-C | 11:10 | 0.03 | 20.2 | 20.2 | 7.46 | 7.5 | 82.4 | 82.5 | 4.1 | 3.8 | 10.1 | 10.1 | 6 | 5.0 |
| WWI3-C | 11.10 | 0.03 | 20.2 | 20.2 | 7.5 | 7.3 | 82.6 | 82.3 | 3.5 | 3.8 | 10.1 | 10.1 | 4 | 3.0 |
| WM3 | 11:20 | 0.15 | 18.4 | 18.4 | 8.23 | 8.2 | 87.8 | 88.0 | 10.5 | 10.6 | 9.5 | 9.5 | 13 | 12.5 |
| VV 1V13 | 11.20 | 0.13 | 18.4 | 10.4 | 8.26 | 0.2 | 88.1 | 88.0 | 10.6 | 10.0 | 9.5 | 7.3 | 12 | 14.3 |




| Date | 25-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|------|------|-------|-------|------|------|----------|----------|-----|-----|------|-------|
| Location | Time | Depth (m) | Temp | (oC) | DO (r | ng/L) | DO | (%) | Turbidit | ty (NTU) | р | Н | SS(n | ng/L) |
| WM2 C | 11.10 | 0.02 | 21.5 | 21.5 | 6.53 | 6.5 | 73.8 | 72.0 | 3.9 | 2.7 | 9.2 | 9.2 | 9 | 9.0 |
| WM3-C | 11:10 | 0.03 | 21.5 | 21.5 | 6.55 | 6.5 | 74.0 | 73.9 | 3.4 | 3.7 | 9.2 | 9.2 | 7 | 8.0 |
| WM3 | 11:25 | 0.15 | 20.5 | 20.5 | 8.28 | 8.3 | 92.5 | 92.6 | 13.3 | 13.3 | 9.3 | 9.3 | 12 | 12.5 |
| W W13 | 11.23 | 0.13 | 20.5 | 20.3 | 8.29 | 8.3 | 92.6 | 92.0 | 13.2 | 13.3 | 9.3 | 9.3 | 13 | 12.3 |


| Date | 27-Jan-17 | | | | | | | | | | | | | |
|----------|-----------|-----------|-----------|------|-----------|-----|--------|------|-----------------|-----|------|------|----------|-----|
| Location | Time | Depth (m) | Temp (oC) | | DO (mg/L) | | DO (%) | | Turbidity (NTU) | | pН | | SS(mg/L) | |
| WM3-C | 11:10 | 0.03 | 21 | 21.0 | 7.34 | 7.4 | 82.7 | 83.6 | 2.9 | 2.7 | 10.2 | 10.2 | 3 | 3.0 |
| | | | 21 | | 7.47 | | 84.4 | | 2.5 | | 10.2 | 10.2 | 3 | |
| WM3 | 11:25 | 0.15 | 18.5 | 18.5 | 8.05 | 8.1 | 86.0 | 86.1 | 2.7 | 2.7 | 9.8 | 9.8 | <2 | <2 |
| | | | 18.5 | 16.3 | 8.06 | | 86.1 | | 2.6 | | 9.8 | | <2 | |


Appendix J


Graphical Plots for Monitoring Result


Air Quality – 1-hour TSP

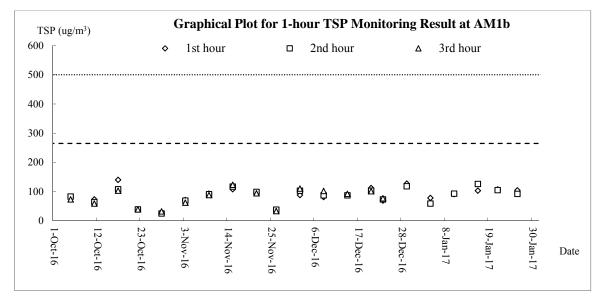


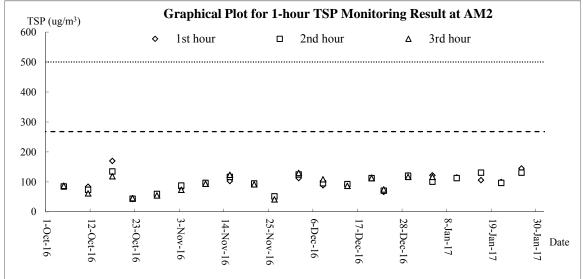


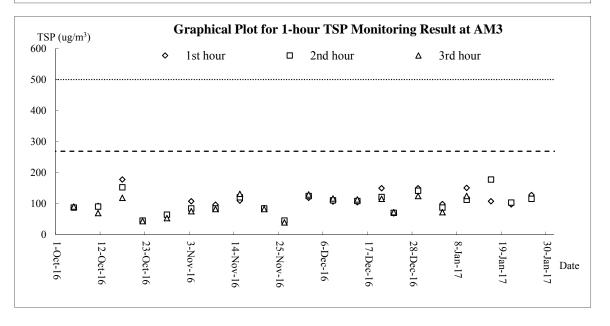


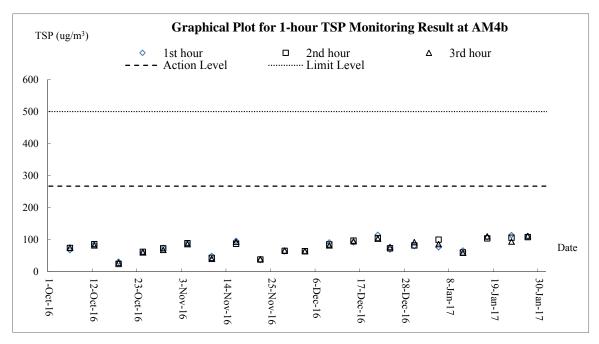


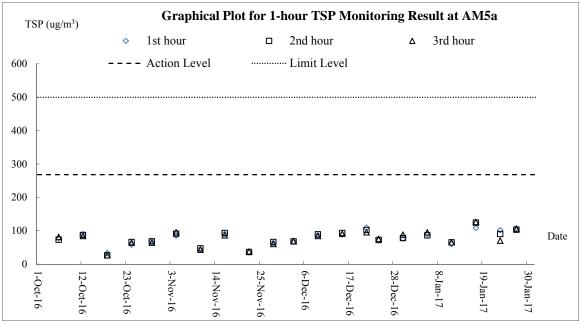

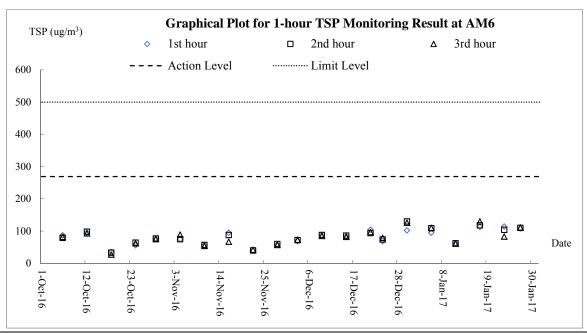


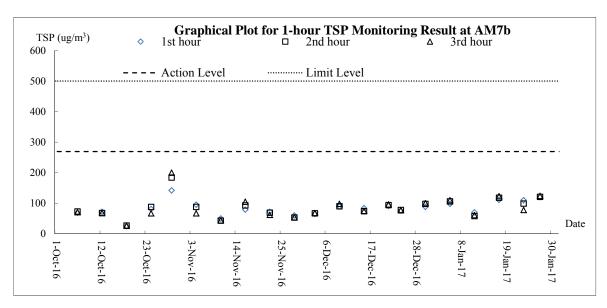


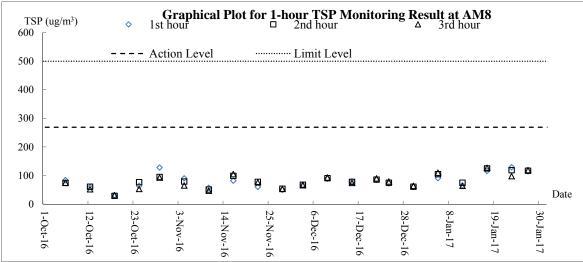


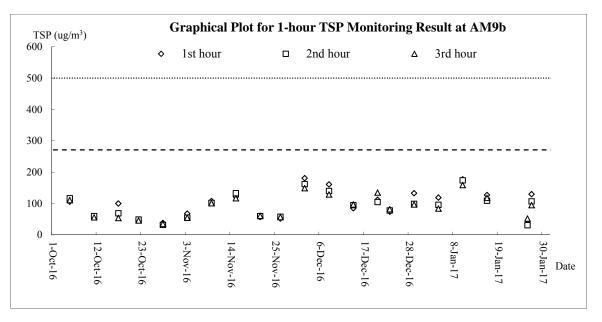



Air Quality – 24-hour TSP

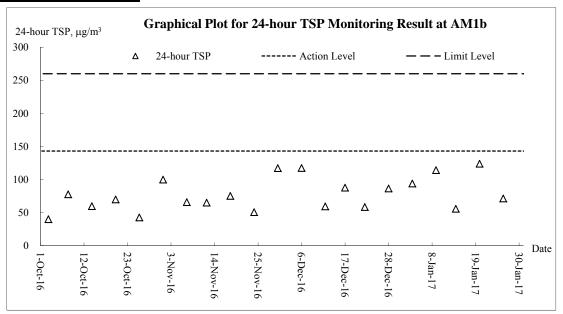


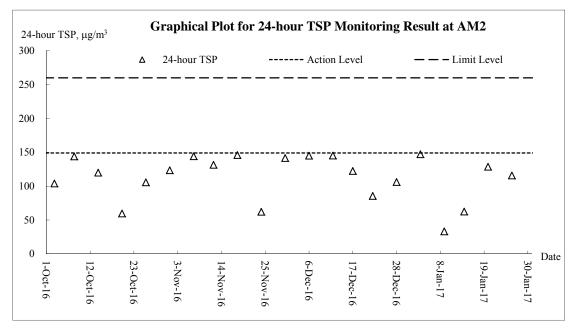


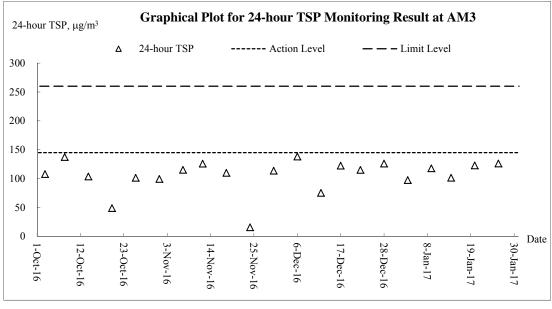


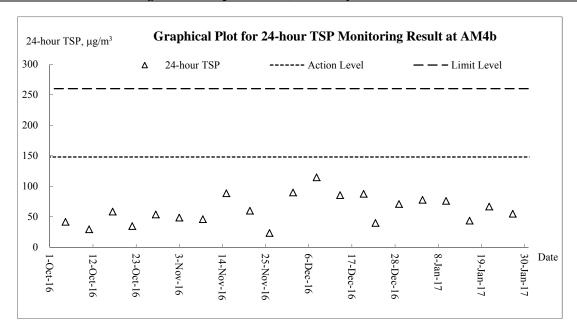


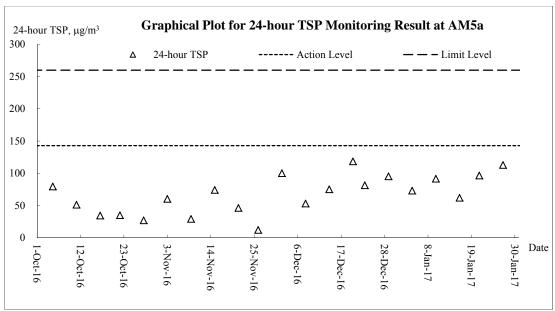

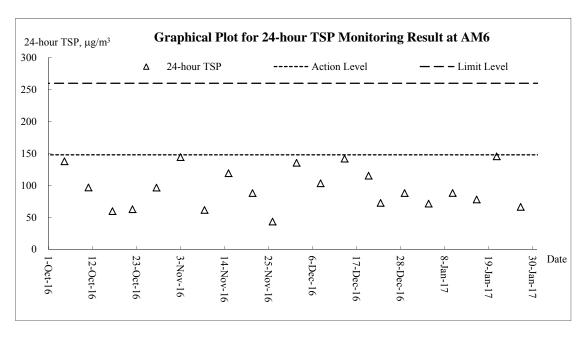


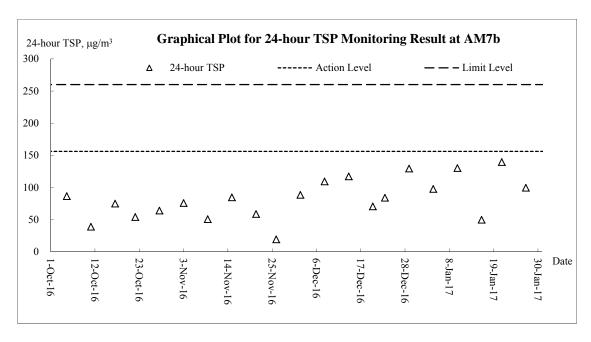


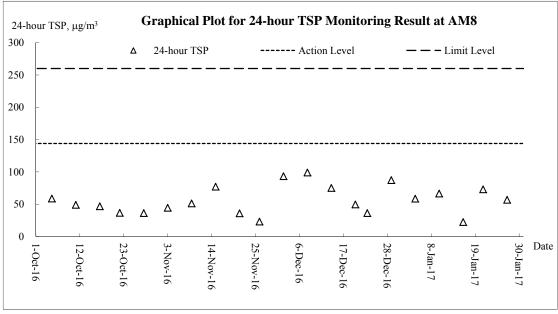


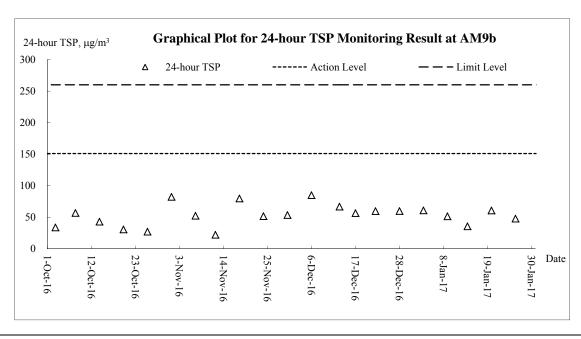



Noise

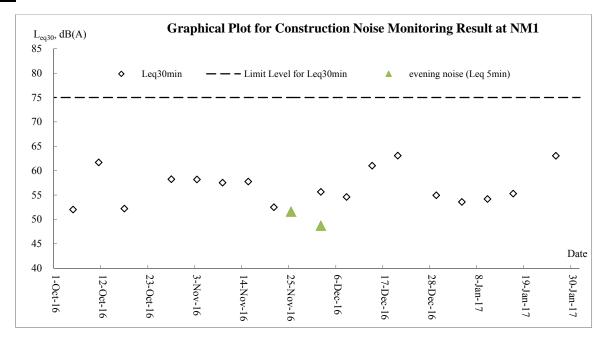


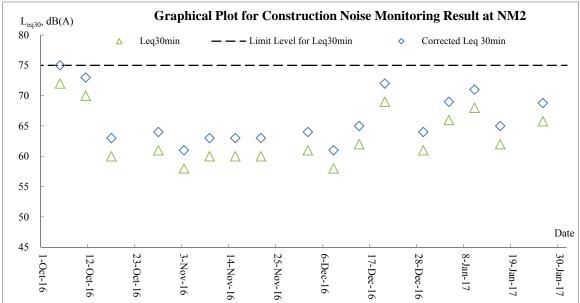


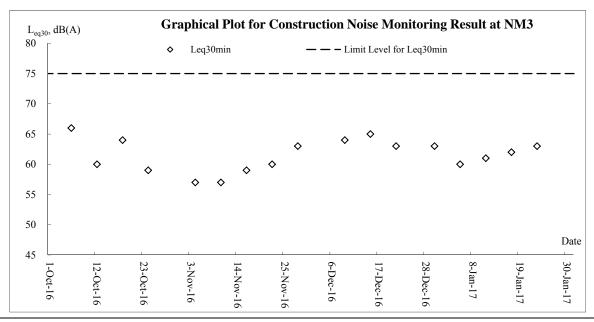


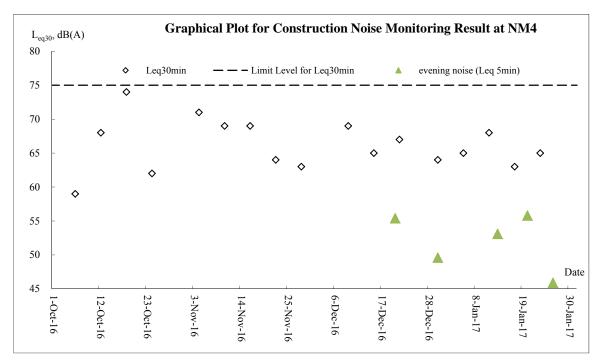


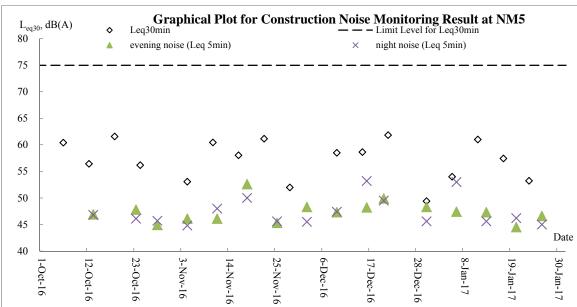


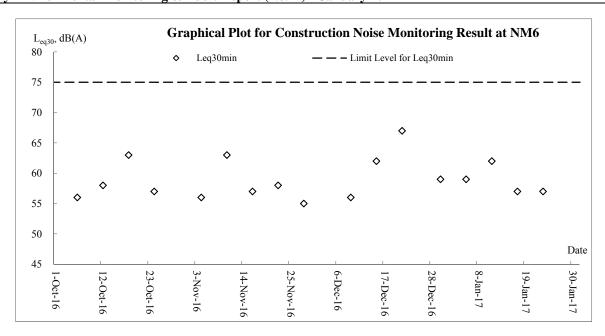

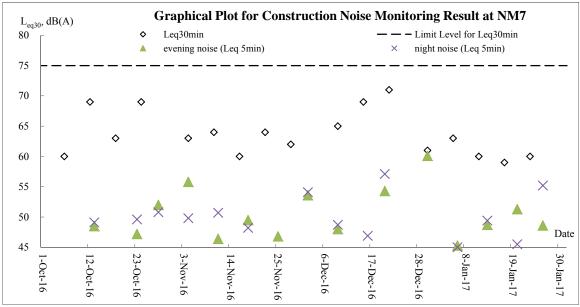


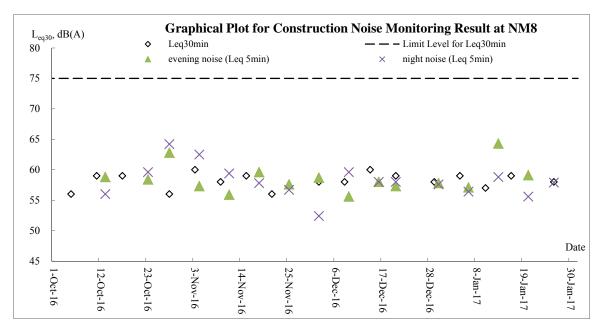


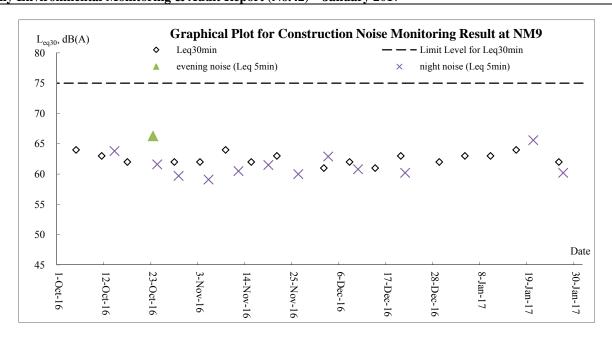


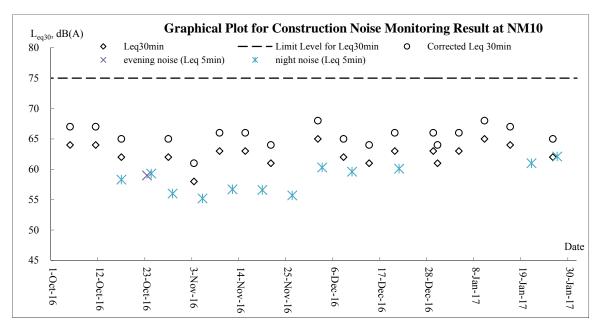



Water Quality

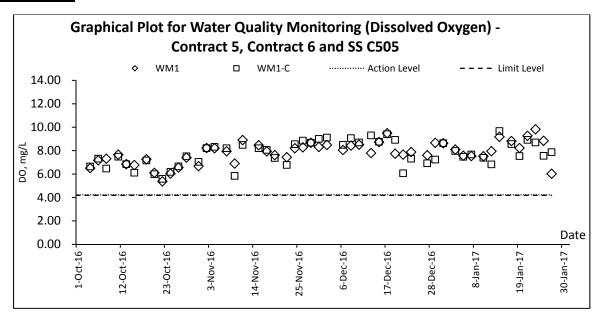


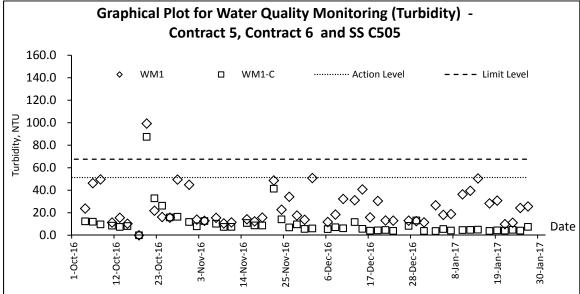


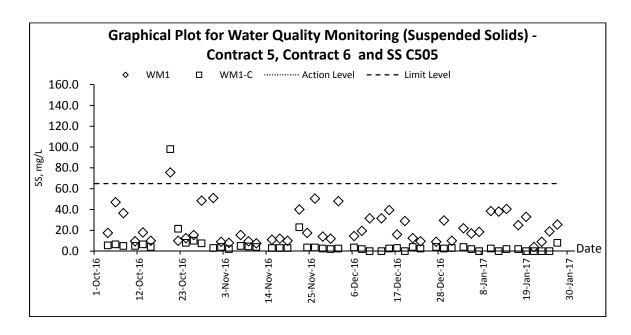


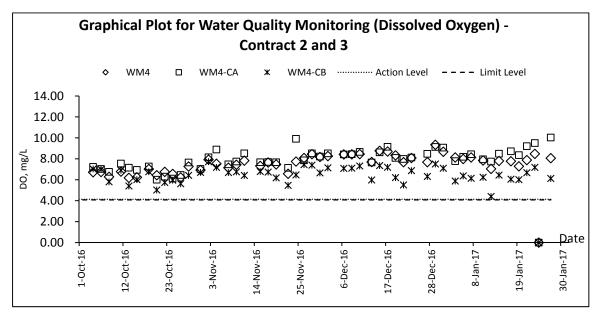


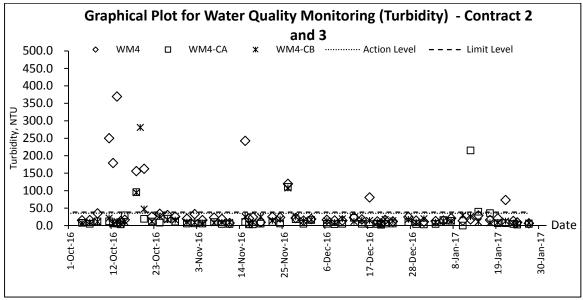


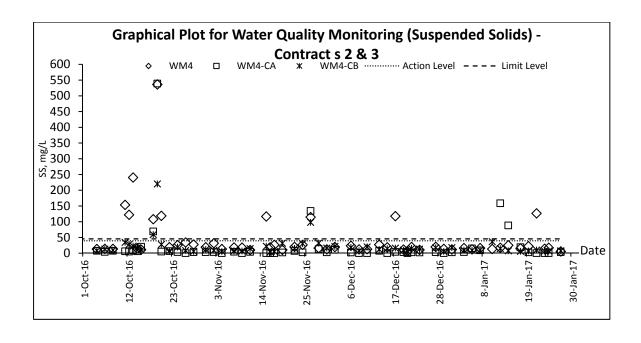


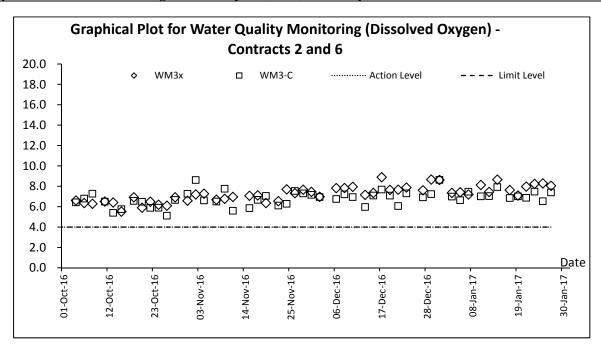


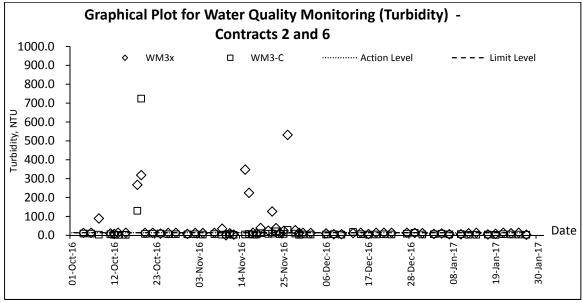


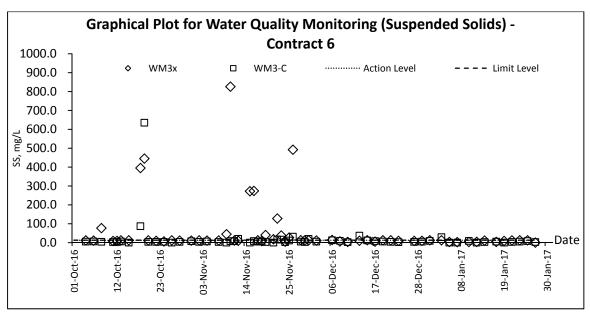


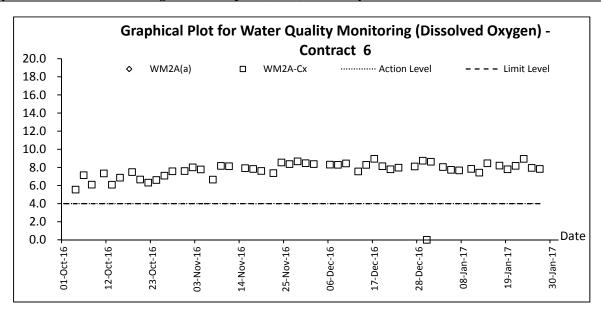


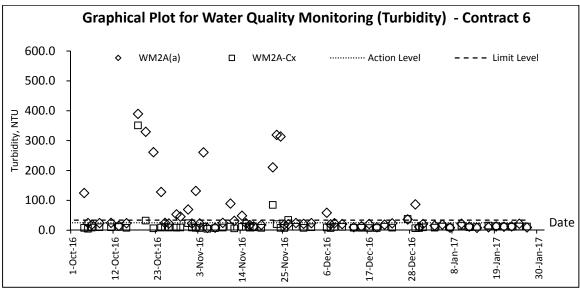

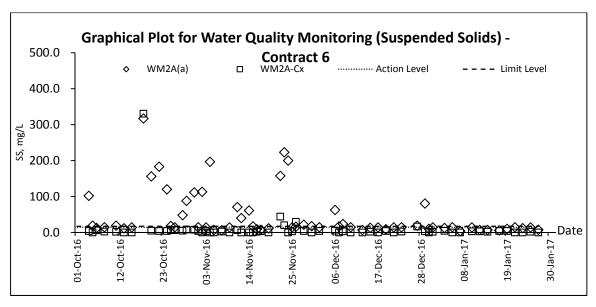

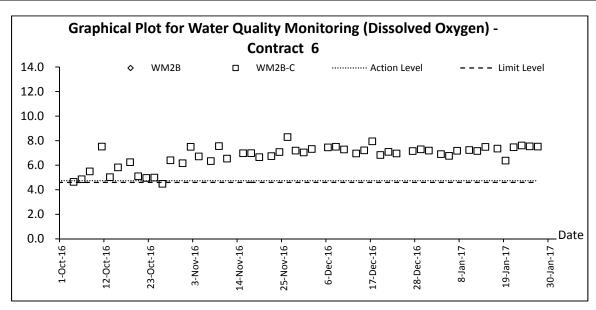

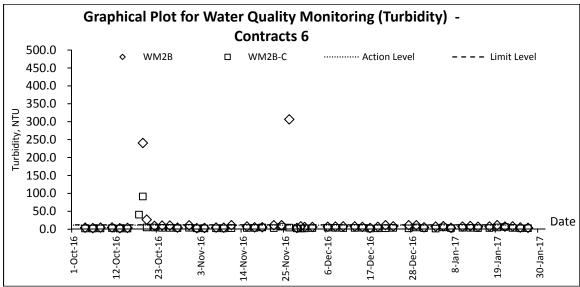

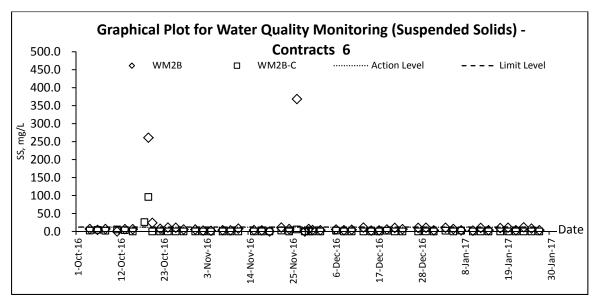

Appendix K

Meteorological Data

| | | | | , | Ta Kwu l | Ling Station | 1 |
|-----------|-----|--|---|---------------------------|-------------------------|-------------------------------------|-------------------|
| Date | | Weather | Total Rainfall (mm) | Mean Air Temp. (°C) | Wind Speed (km/h) | Mean Relative Humidity (%) | Wind Direction |
| 1-Jan-17 | Sun | Sunny periods. Moderate easterly winds, fresh at first. | 0 | 20.4 | 9 | 79.5 | E/NE |
| 2-Jan-17 | Mon | Sunny periods. Moderate easterly winds, fresh at first. | 0 | 20.8 | 8.5 | 82.5 | E/NE |
| 3-Jan-17 | Tue | Sunny periods. Moderate easterly winds, fresh at first. | 0 | 18.9 | 7 | 82 | E/NE |
| 4-Jan-17 | Wed | Sunny periods. Moderate easterly winds, fresh at first. | 0 | 21.3 | 8 | 71 | E/NE |
| 5-Jan-17 | Thu | Sunny periods. Moderate easterly winds, fresh at first. 0 20.6 5.7 77.2 | | | | | E/NE |
| 6-Jan-17 | Fri | Warm in the afternoon. Light to moderate easterly winds. 0 22.5 5.8 73 | | | | | E/NE |
| 7-Jan-17 | Sat | Moderate east to northeasterly winds. | 0 | 22.7 | 5.6 | 65.8 | E/NE |
| 8-Jan-17 | Sun | Sunny periods. Moderate easterly winds, fresh at first. | 0 | 22.5 | 5 | 70 | N/NW |
| 9-Jan-17 | Mon | Sunny periods. Moderate easterly winds, fresh at first. | 0 | 19.7 | 6 | 75.5 | E/NE |
| 10-Jan-17 | Tue | Warm in the afternoon. Light to moderate easterly winds. | 0 | 19.7 | 9.1 | 71.7 | E/NE |
| 11-Jan-17 | Wed | Moderate east to northeasterly winds. | 0 | 19.1 | 6.4 | 77 | Е |
| 12-Jan-17 | Thu | Sunny periods. Moderate easterly winds, fresh at first. | Trace | 15.9 | 6.5 | 78.5 | N/NW |
| 13-Jan-17 | Fri | Sunny periods. Moderate easterly winds, fresh at first. | 0.5 | 13.5 | 9.3 | 80 | N/NW |
| 14-Jan-17 | Sat | Warm in the afternoon. Light to moderate easterly winds. | 1 | 13.1 | 8.9 | 92.5 | N/NE |
| 15-Jan-17 | Sun | Moderate east to northeasterly winds. | 1.5 | 13.4 | 6.5 | 86.5 | N/NW |
| 16-Jan-17 | Mon | Visibility relatively low in some areas. | 0.4 | 14.5 | 4.9 | 82.5 | N/NW |
| 17-Jan-17 | Tue | Mainly cloudy with one or two light rain patches | 0 | 17.7 | 7.4 | 72.5 | E/NE |
| 18-Jan-17 | Wed | Moderate east to northeasterly winds. | Trace | 18.8 | 4.5 | 81.7 | E/NE |
| 19-Jan-17 | Thu | Mainly fine and dry. Cool | 0 | 20.8 | 4.5 | 82.2 | N/NW |
| 20-Jan-17 | Fri | Mainly fine and dry. Cool | 3.4 | 17.1 | 11.3 | 62.5 | N/NW |
| 21-Jan-17 | Sat | Moderate east to northeasterly winds. | 0 | 16 | 11.5 | 45.2 | E/SE |
| 22-Jan-17 | Sun | Mainly fine and dry. Cool | 3.4 | 14.2 | 3.5 | 72.5 | S/SE |
| 23-Jan-17 | Mon | Mainly fine and dry. Cool | 0 | 15.6 | 7.2 | 67 | E/NE |
| 24-Jan-17 | Tue | Fine. Dry during the day. Moderate easterly winds, fresh at times tonight. | 0 | 18.5 | 7.4 | 63.5 | E/NE |
| 25-Jan-17 | Wed | Fine. Dry during the day. Moderate easterly winds, fresh at times tonight. | 0 | 18.9 | 6.7 | 68.7 | E/NE |
| 26-Jan-17 | Thu | Mainly fine and dry. Cool | 0 | 16.3 | 6.6 | 67 | E/NE |
| 27-Jan-17 | Fri | Fine. Dry during the day. Moderate easterly winds, fresh at times tonight. | Ory during the day. Moderate easterly 0 17.2 6.5 68.2 | | 68.2 | E/NE | |
| 28-Jan-17 | Sat | Moderate to fresh easterly winds | 0.3 | 16.9 | 8.1 | 75.6 | E/NE |
| 29-Jan-17 | Sun | Mainly cloudy with bright periods | 2.4 | 20.5 | 7.5 | 85.9 | E/NE |
| 30-Jan-17 | Mon | Moderate to fresh easterly winds | 1.2 | 20 | 5.8 | 89.8 | E/NE |
| 31-Jan-17 | Tue | Mainly cloudy with bright periods | 0.5 | 16 | 4.6 | 78.2 | E/NE |

Appendix L

Waste Flow Table



| Name of Department : | CEDD | Contract No./ Work Order No. : | CV/2012/08 |
|----------------------|------|--------------------------------|------------|
| | _ | | |

Appendix I - Monthly Summary Waste Flow Table for 2017

(All quantities shall be rounded off to 3 decimal places)

| | | Actual Quanti | ties of Inert C&D Materia | als Generated / Importe | ed (in '000 m3) | | | Actual Quantities of | of Other C&D Materials | Wastes Generated | |
|-----------------|-------------------------------|--|---------------------------|-----------------------------|----------------------------|--------------------------|-------------|-------------------------------|--|------------------|-----------------------------------|
| Month | Total Quantities Generated | Broken Concrete (including rock for recycling into aggregates) | Reused in the Contract | Reused in Other Projects | Disposed as Public Fill | Imported C&D Material | Metal | Paper/ Cardboard Packaging | Plastic (bottles/containers, plastic sheets/ foams from package material) | Chemical Waste | Others (e.g. General Refuse etc.) |
| | [a+b+c+d) | (a) | (b) | (c) | (d) | | (in '000kg) | (in '000kg) | (in '000kg) | (in '000kg) | (in '000m3) |
| January | 59.9685 | 0.0000 | 0.4203 | 26.9277 | 32.6205 | 1.7050 | 9.6870 | 0.3000 | 2.3000 | 1.7600 | 0.1931 |
| February | 0.0000 | | | | | | | | | | |
| March | 0.0000 | | | | | | | | | | |
| April | 0.0000 | | | | | | | | | | |
| May | 0.0000 | | | | | | | | | | |
| June | 0.0000 | | | | | | | | | | |
| Half-year total | 59.9685 | 0.0000 | 0.4203 | 26.9277 | 32.6205 | 1.7050 | 9.6870 | 0.3000 | 2.3000 | 1.7600 | 0.1931 |
| July | 0.0000 | | | | | | | | | | |
| August | 0.0000 | | | | | | | | | | |
| September | 0.0000 | | | | | | | | | | |
| October | 0.0000 | | | | | | | | | | |
| November | 0.0000 | | | • | | | | | | | |
| December | 0.0000 | | | | | | | | | | |
| Yearly Total | 59.9685 | 0.0000 | 0.4203 | 26.9277 | 32.6205 | 1.7050 | 9.6870 | 0.3000 | 2.3000 | 1.7600 | 0.1931 |

(All quantities shall be rounded off to 3 decimal places)

| | | Actual Quantities of Inert C&D Materials Generated / Imported (in '000 m3) | | | | | | Actual Quantities of Other C&D Materials / Wastes Generated | | | | | |
|-------|-------------------------------|--|------------------------|-----------------------------|----------------------------|--------------------------|-------------|---|--|----------------|-----------------------------------|--|--|
| Year | Total Quantities Generated | Broken Concrete (including rock for recycling into aggregates) | Reused in the Contract | Reused in Other Projects | Disposed as Public Fill | Imported C&D Material | Metal | Paper/ Cardboard Packaging | Plastic (bottles/containers, plastic sheets/ foams from package material) | Chemical Waste | Others (e.g. General Refuse etc.) | | |
| | [a+b+c+d) | (a) | (b) | (c) | (d) | | (in '000kg) | (in '000kg) | (in '000kg) | (in '000kg) | (in '000m3) | | |
| 2013 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | 0.0000 | | |
| 2014 | 425.4406 | 0.0000 | 2.7362 | 376.3945 | 46.3099 | 5.6245 | 3.2100 | 0.4390 | 0.0070 | 10.8800 | 2.2609 | | |
| 2015 | 570.9459 | 0.0000 | 20.8159 | 543.2162 | 6.9138 | 4.5492 | 14.1300 | 3.9220 | 11.9700 | 16.1920 | 1.1696 | | |
| 2016 | 905.0989 | 0.0000 | 7.4372 | 427.7834 | 469.8783 | 24.8350 | 259.2290 | 3.8500 | 18.7262 | 34.2936 | 1.9720 | | |
| 2017 | 59.9685 | 0.0000 | 0.4203 | 26.9277 | 32.6205 | 1.7050 | 9.6870 | 0.3000 | 2.3000 | 1.7600 | 0.1931 | | |
| 2018 | | | | | | | | | | | | | |
| Total | 1961.4539 | 0.0000 | 31.4096 | 1374.3219 | 555.7224 | 36.7137 | 286.2560 | 8.5110 | 33.0032 | 63.1256 | 5.5956 | | |

| D | ~- | | _ | _ | ۱. | |
|---|----|---|---|---|----|--|
| ĸ | | n | a | п | ĸ | |

|) Density of C&D material to be | 2.2 | metric ton/m |
|---------------------------------|-----|--------------|
| Density of General Refuse to be | 1.6 | metric ton/m |

| | 3) | Density | of S | Spent | Oil | to | be |
|--|----|---------|------|-------|-----|----|----|
|--|----|---------|------|-------|-----|----|----|

| 0.88 | metric ton/m3 |
|------|---------------|

Name of Department: CEDD Contract No.: CV/2012/09

Monthly Summary Waste Flow Table for 2017 (year)

| | Actua | | of Inert C&D | Materials G | enerated Mo | onthly | Actual | Quantities o | f C&D Wastes | Generated | Monthly |
|------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|--------------------------|-----------|--------------------------|
| | | Hard Rock | | _ | | | | _ | | | |
| Month | Total | and Large | Reused in | Reused in | Disposed | | | Paper/ | | | Others, e.g. |
| Wionth | Quantity | Broken | the | other | as Public | Imported | | cardboard | | Chemical | general |
| | Generated | Concrete | Contract | Projects | Fill | Fill | Metals | packaging | Plastics | Waste | refuse |
| | (in '000m ³) | (in m³) | (in '000m ³) |
| Jan | 1.150 | 0.204 | 0.150 | 0.000 | 0.796 | 1.150 | 0.000 | 0.000 | 0.001 | 0.000 | 0.170 |
| Feb | | | | | | | | | | | |
| Mar | | | | | | | | | | | |
| Apr | | | | | | | | | | | |
| May | | | | | | | | | | | |
| Jun | | | | | | | | | | | |
| Sub-total | 1.150 | 0.204 | 0.150 | 0.000 | 0.796 | 1.150 | 0.000 | 0.000 | 0.001 | 0.000 | 0.170 |
| Jul | | | | | | | | | | | |
| Aug | | | | | | | | | | | |
| Sep | | | | | | | | | | | |
| Oct | | | | | | | | | | | |
| Nov | | | | | | | | | | | |
| Dec | | | | | | | | | | | |
| Total | 1.150 | 0.204 | 0.150 | 0.000 | 0.796 | 1.150 | 0.000 | 0.000 | 0.001 | 0.000 | 0.170 |

Note:

- 1. Assume the density of soil fill is 2 ton/m³.
- 2. Assume the density of rock and broken concrete is 2.5 ton/m³.
- 3. Assume each truck of C&D wastes is 5m³.
- 4. The inert C&D materials except slurry and bentonite are disposed at Tuen Mun 38.
- 5. The slurry and bentonite are disposed at Tseung Kwun O 137.
- 6. The non-inert C&D wastes are disposed at NENT.
- 7. Assume the density of metal is 7,850 kg/m³.
- 8. Assume the density of plastic is 941 kg/m³.

Monthly Summary Waste Flow Table for <u>2017</u> (year)

Name of Person completing the record: K.M. Lui (EO)

Project: Liangtang / Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works – Contract 6 Contract No.: CV/2013/08

| Troject : E | Actual Quantities of Inert C&D Materials Generated Monthly Actual Quantities of C&D Waste | | | | | | | | | es Generated Monthly | | |
|-------------|--|--|--------------------------|--------------------------------|----------------------------|--------------------------|--------------|----------------------------------|-----------------------|----------------------|-----------------------------------|--|
| Month | Total Quantity Generated | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals | Paper/ cardboard packaging | Plastics (see Note 3) | Chemical Waste | Others, e.g. general refuse | |
| | (in '000m ³) | (in '000m ³) | (in '000m ³) | (in '000m ³) | (in '000m ³) | (in '000m ³) | (in '000 kg) | (in '000kg) | (in '000kg) | (in '000kg) | (in '000 m ³) | |
| Jan | 39.926 | 0 | 19.095 | 6.067 | 14.764 | 0 | 0 | 0 | 0 | 0 | 0.065 | |
| Feb | | | | | | | | | | | | |
| Mar | | | | | | | | | | | | |
| Apr | | | | | | | | | | | | |
| May | | | | | | | | | | | | |
| Jun | | | | | | | | | | | | |
| Sub-total | 39.926 | 0 | 19.095 | 6.067 | 14.764 | 0 | 0 | 0 | 0 | 0 | 0.065 | |
| Jul | | | | | | | | | | | | |
| Aug | | | | | | | | | | | | |
| Sep | | | | | | | | | | | | |
| Oct | | | | | | | | | | | | |
| Nov | | | | | | | | | | | | |
| Dec | | | | | | | | | | | | |
| Total | 783.088 | 0 | 102.786 | 204.359 | 475.943 | 53.939 | 0 | 2.773 | 0.007 | 33.755 | 4.917 | |

Notes:

- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (2) Plastics refer to plastic bottles/containers, plastic sheets/ foam from packaging materials.
- (3) Broken concrete for recycling into aggregates.

MONTHLY SUMMARY WASTE FLOW TABLE

| Name of Depart | ment: CEDD | | |
|-----------------|---|---------------|------------|
| Contract Title: | Liantang/ Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works – Contract 7 | Contract No.: | NE/2014/03 |

Monthly Summary Waste Flow Table for <u>2017</u> (year)

| | Actual Quantities of Inert C&D Materials Generated Monthly Actual Quantities of Inert C&D Wastes Generated Monthly | | | | | | ly | | | | |
|-----------|---|---|---------------------------|-----------------------------|----------------------------|---------------|-------------|---------------------------|----------------------|----------------|-----------------------------|
| Month | Total Quantity Generated | Hard Rock and Large Broken Concrete | Reused in the Contract | Reused in other Projects | Disposed as Public Fill | Imported Fill | Metals | Paper/cardboard packaging | Plastic (see Note 3) | Chemical Waste | Others, e.g. general refuse |
| | (in '000m ³) | (in '000m3) | (in '000m3) | (in '000m3) | (in '000m3) | (in '000m3) | (in '000kg) | (in '000kg) | (in '000kg) | (in '000kg) | (in '000m3) |
| Jan | 0 | 0 | 0 | 0 | 0 | 0 | 0.1 | 0.05 | 0.001 | 0 | 0.01 |
| Feb | | | | | | | | | | | |
| Mar | | | | | | | | | | | |
| Apr | | | | | | | | | | | |
| May | | | | | | | | | | | |
| June | | | | | | | | | | | |
| Sub-total | 0 | 0 | 0 | 0 | 0 | 0 | 0.1 | 0.05 | 0.001 | 0 | 0.01 |
| July | | | | | | | | | | | |
| Aug | | | | | | | | | | | |
| Sept | | | | | | | | | | | |
| Oct | | | | | | | | | | | |
| Nov | | | | | | | | | | | |
| Dec | | | | | | | | | | | |
| Total | 0 | 0 | 0 | 0 | 0 | 0 | 0.1 | 0.05 | 0.001 | 0 | 0.01 |

Notes: (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.

(2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.

| Architectural Services Department | Architectural | Services | Department |
|--|---------------|-----------------|-------------------|
|--|---------------|-----------------|-------------------|

Form No. D/OI.03/09.002

Contract No. / Works Order No.: - SSC505

Monthly Summary Waste Flow Table for 2017 [year] [to be submitted not later than the 15th day of each month following reporting month]

(All quantities shall be rounded off to 3 decimal places.)

| | | Actual Quantities of Inc | ert Construction Waste Ge | nerated Monthly | |
|-----------|--|--|---------------------------|---------------------------------|-----------------------------------|
| Month | (a)=(b)+(c)+(d)+(e) Total Quantity Generated | (b) Broken Concrete (see Note 4) | Reused in the Contract | (d) Reused in other Projects | (e) Disposed of as Public Fill |
| | (in '000m ³) | (in '000m ³) | (in '000m ³) | (in '000m ³) | (in '000m ³) |
| Jan | 3.160 | 0 | 2.003 | 0 | 1.157 |
| Feb | 1 | - | - | - | - |
| Mar | - | - | - | - | - |
| Apr | - | - | - | - | - |
| May | - | - | - | - | - |
| Jun | - | - | - | - | - |
| Sub-total | 3.16 | 0 | 2.003 | 0 | 1.157 |
| Jul | - | - | - | - | - |
| Aug | - | - | - | - | - |
| Sep | - | - | - | - | - |
| Oct | - | - | - | - | - |
| Nov | - | - | - | - | - |
| Dec | 1 | - | - | - | |
| Total | 3.16 | 0 | 2.003 | 0 | 1.157 |

| | | | | | Actual Qua | ntities of Nor | n-inert Constr | uction Waste | Generated M | onthly | | | |
|-----------|-----------|----------|-----------|----------|----------------------------|----------------|--------------------------|--------------|----------------|----------|--|----------|--|
| Month | Timber | | Metals | | Paper/ cardboard packaging | | Plastics (see Note 3) | | Chemical Waste | | Other Recyclable Materials (see Page 3) | | General Refuse disposed of at Landfill |
| | (in '0 | 00kg) | (in '0 | 00kg) | (in '0 | 00kg) | (in '0 | 00kg) | (in '0 | 00kg) | (in '0 | 00kg) | (in '000m ³) |
| | generated | recycled | generated | recycled | generated | recycled | generated | recycled | generated | recycled | generated | recycled | generated |
| Jan | 0.000 | 0.000 | 458.150 | 458.150 | 0.560 | 0.560 | 0.058 | 0.058 | 0.000 | 0.000 | 0.024 | 0.024 | 0.481 |
| Feb | - | - | - | - | - | = | - | - | - | - | - | = | - |
| Mar | - | - | - | - | - | - | - | - | - | - | - | - | - |
| Apr | - | 1 | - | - | - | - | - | 1 | - | 1 | - | ı | - |
| May | - | 1 | - | - | - | - | - | 1 | - | 1 | - | ı | - |
| Jun | - | 1 | - | - | - | - | - | 1 | - | 1 | - | ı | - |
| Sub-total | 0 | 0 | 458.150 | 458.150 | 0.560 | 0.560 | 0.058 | 0.058 | 0.000 | 0.000 | 0.024 | 0.024 | 0.481 |
| Jul | - | - | - | - | - | - | - | - | - | - | - | - | - |
| Aug | - | ı | - | - | - | - | - | ı | - | ı | - | ı | = |
| Sep | - | ı | - | - | - | - | - | ı | - | ı | - | ı | - |
| Oct | - | - | - | - | - | - | - | - | - | - | - | - | = |
| Nov | - | - | - | - | - | - | - | - | - | - | - | - | - |
| Dec | - | - | - | - | - | - | - | - | - | - | - | - | - |
| Total | 0 | 0 | 458.150 | 458.150 | 0.560 | 0.560 | 0.058 | 0.058 | 0.000 | 0.000 | 0.024 | 0.024 | 0.481 |

| • | Description of mode and details of recycling if any for the month e.g. XX kg of used timber was sent to YY site for transformation into fertilizers | | | | | | | | | | | |
|---|---|---|--|--|--|--|--|--|--|--|--|--|
| 12kg of cans was sent to Kong Han for recycling and 560kg of paper was sent to Wai San for recycling. | 58kg of plastic bottles and 12kg of glass bottles were sent to Action Health for recycling. | 458.15 tons of scrap metals from LCAL were sent for recycling | | | | | | | | | | |

Notes:

- (1) The performance targets are given in the Particular Specification on Environmental Management Plan.
- (2) The waste flow table shall also include construction waste that are specified in the Contract to be imported for use at the site.
- (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
- (4) Broken concrete for recycling into aggregates.
- (5) If necessary, use the conversion factor: 1 full load of dumping truck being equivalent to 6.5 m³ by volume.

Appendix M

Implementation Schedule for Environmental Mitigation Measures



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement the | Location of the measure | When to implement the | What requirements or standards for the measure to |
|-----------|--------------|--|---|----------------------|-----------------------------|------------------------|--|
| | nei. | | & Main Concerns to address | measure? | ilicasuic | measure? | achieve? |
| Air Quali | ty Impact (| Construction) | | | | | |
| 3.6.1.1 | 2.1 | General Dust Control Measures The following dust suppression measures should be implemented: Frequent water spraying for active construction areas (4 times per day for active areas in Po Kak Tsai and 8 times per day for all other active areas), including areas with heavy construction and slope cutting activities 80% of stockpile areas should be covered by impervious sheets Speed of trucks within the site should be controlled to about 10 km/hr All haul roads within the site should be paved to avoid dust | To minimize adverse dust emission generated from various construction activities of the works sites | Contractor | Construction Works Sites | During Construction | EIA Recommendation and Air Pollution Control (Construction Dust) Regulation |
| | | emission due to vehicular movement | | | | | |
| 3.6.1.2 | 2.1 | Best Practice for Dust Control The relevant best practices for dust control as stipulated in the Air Pollution Control (Construction Dust) Regulation should be adopted to further reduce the construction dust impacts of the Project. These best practices include: Good site management | To minimize adverse dust emission generated from various construction activities of the works sites | Contractor | Construction Works Sites | During Construction | EIA Recommendation and Air Pollution Control (Construction Dust) Regulation |
| | | The Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust. Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimize the release of visible dust emission. | | | | | |
| | | Any piles of materials accumulated on or around the work areas should be cleaned up regularly. | | | | | |
| | | Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimizing generation of fugitive dust emissions. | | | | | |
| | | The material should be handled properly to prevent fugitive dust emission before cleaning. Disturbed Parts of the Roads | | | | | |
| | | Each and every main temporary access should be paved with | | | | | |



Objectives of the What requirements Who to Recommended When to **Recommended Mitigation Measures** EM&A implement Location of the or standards for the EIA Ref. Measure implement the Ref. the measure measure to measure? & Main Concerns measure? achieve? to address

concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or

 Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.

Exposed Earth

Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.

Loading, Unloading or Transfer of Dusty Materials

 All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.

Debris Handlina

- Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides.
- Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.

Transport of Dusty Materials

 Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.

Wheel washing

Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.

Use of vehicles

- Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.
- Where a vehicle leaving the construction site is carrying a load of dusty materials, the load should be covered entirely by clean impervious sheeting to ensure that the dusty materials do not leak from the vehicle.



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure & Main Concerns to address | Who to implement the measure? | Location of the measure | When to implement the measure? | What requirements or standards for the measure to achieve? |
|------------|--------------|---|--|-------------------------------|----------------------------|--------------------------------|---|
| | | Site hoarding Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit. Blasting The areas within 30m from the blasting area should be wetted with water prior to blasting. | | | | | |
| Air Qualit | ty Impact (| Operation) | | | | | |
| 3.5.2.2 | 2.2 | The following odour containment and control measures will be provided for the proposed sewage treatment work at the BCP site: The treatment work will be totally enclosed. Negative pressure ventilation will be provided within the enclosure to avoid any fugitive odorous emission from the treatment work. Further odour containment will be achieved by covering or confining the sewage channels, sewage tanks, and equipment with potential odour emission. Proper mixing will be provided at the equalization and sludge holding tanks to prevent sewage septicity. Chemical or biological deodorisation facilities with a minimum odour removal efficiency of 90% will be provided to treat potential odorous emissions from the treatment plant including sewage channels / tanks, filter press and screening facilities so as to minimize any potential odour impact to the nearby ASRs. | To minimize potential odour impact from operation of the proposed sewage treatment work at BCP | DSD | BCP | Operation Phase | EIA recommendation |
| Noise Im | pact (Cons | truction) | | | | | |
| 4.4.1.4 | 3.1 | Adoption of Quieter PME Use of the recommended quieter PME such as those given in the BS5228: Part 1:2009 and presented in Table 4.14 , which can be found in Hong Kong. | To minimize the construction air-borne noise impact | Contractors | Construction Work Sites | During Construction | EIA recommendation, EIAO and Noise Control Ordinance (NCO) |



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure & Main Concerns to address | Who to implement the measure? | Location of the measure | When to implement the measure? | What requirements or standards for the measure to achieve? |
|----------|--------------|--|--|-------------------------------|----------------------------|--------------------------------|--|
| 4.4.1.4 | 3.1 | Use of Movable Noise Barrier The use of movable barrier for certain PME can further alleviate the construction noise impacts. In general, a 5 dB(A) reduction for movable PME and 10 dB(A) for stationary PME can be achieved depending on the actual design of the movable noise barrier. The Contractor shall be responsible for design of the movable noise barrier with due consideration given to the size of the PME and the requirement for intercepting the line of sight between the NSRs and PME. Barrier material with surface mass in excess of 7 kg/m² is recommended to achieve the predicted screening effect. | To minimize the construction airborne noise impact | Contractors | Construction Work Sites | During Construction | EIA recommendation, EIAO and NCO |
| 4.4.1.4 | 3.1 | Use of Noise Enclosure/ Acoustic Shed The use of noise enclosure or acoustic shed is to cover stationary PME such as air compressor and concrete pump. With the adoption of the noise enclosure, the PME could be completely screened, and noise reduction of 15 dB(A) can be achieved according to the GW-TM. | To minimize the construction airborne noise impact | Contractors | Construction Work Sites | During Construction | EIA recommendation, EIAO and NCO |
| 4.4.1.4 | 3.1 | Use of Noise Insulating Fabric Noise insulating fabric can be adopted for certain PME (e.g. drill rig, pilling auger etc). The insulating fabric should be lapped such that there are no openings or gaps on the joints. Technical data from manufacturers state that by using the Fabric, a noise reduction of over 10 dB(A) can be achieved on noise level. | To minimize the construction airborne noise impact | Contractors | Construction Work Sites | During Construction | EIA recommendation, EIAO and NCO |



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement the | Location of the measure | When to implement the | What requirements or standards for the measure to |
|--|--------------|---|---|---|---|-----------------------|---|
| | | | & Main Concerns to address | measure? | | measure? | achieve? |
| 4.4.1.4 | 3.1 | Good Site Practice | To minimize the | Contractors | Construction | During | EIA recommendation, |
| | | The good site practices listed below should be followed during each phase of construction: | construction air- borne noise impact | | Work Sites | Construction | EIAO and NCO |
| | | Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; | | | | | |
| | | Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction programme; | | | | | |
| | | • Mobile plant, if any, should be sited as far from NSRs as possible; | | | | | |
| | | Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; | | | | | |
| | | Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and | | | | | |
| | | Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities. | | | | | |
| Noise Im | pact (Oper | ration) | | | | | |
| | | Road Traffic Noise | | | | | |
| Table 4.42 and Figure 4.20.1 to | 3.2 | Erection of noise barrier/ enclosure along the viaduct section. | To minimize the road traffic noise along the connecting road of BCP | Contractor | Loi Tung and Fanling Highway Interchange | Before Operation | EIAO and NCO |
| 4.20.4 | | Fixed Plant Noice | | | | | |
| Table | 3.2 | Fixed Plant Noise Specification of the maximum allowable sound power levels of the | To minimize the | Managing | BCP, | Before | EIA recommendation, |
| 4.46 | J. <u>C</u> | proposed fixed plants during daytime and night-time. | fixed plant noise impact | Authority of the buildings / Contractor | Administration Building and all ventilation buildings | Operation | EIAO and NCO |



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement the | Location of the measure | When to implement the | What requirements or standards for the measure to |
|----------|--------------|---|--|---|--|-----------------------|---|
| | nei. | | & Main Concerns to address | measure? | ilicasuic | measure? | achieve? |
| 4.5.2.4 | 3.2 | The following noise reduction measures shall be considered as far as practicable during operation: Choose quieter plant such as those which have been effectively silenced; Include noise levels specification when ordering new plant (including chillier and E/M equipment); Locate fixed plant/louver away from any NSRs as far as practicable; Locate fixed plant in walled plant rooms or in specially designed enclosures; Locate noisy machines in a basement or a completely separate building; Install direct noise mitigation measures including silencers, acoustic louvers and acoustic enclosure where necessary; and Develop and implement a regularly scheduled plant maintenance | To minimize the fixed plant noise impact | Managing Authority of the buildings / Contractor | BCP, Administration Building and all ventilation buildings | Before Operation | EIAO and NCO |
| Water Ou | uolity Impo | programme so that equipment is properly operated and serviced in order to maintain a controlled level of noise. | | | | | |
| | | ct (Construction) | To control site runoff and drainage; prevent high sediment loading from reaching the nearby watercourses | Contractor | tor Construction Works Sites | Construction Phase | Practice Note for Professional Persons on Construction Site Drainage (ProPECC Note PN 1/94) |
| 5.6.1.1 | 4.1 | Construction site runoff and drainage The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended to protect water quality and when properly implemented should be sufficient to adequately control site discharges so as to avoid water quality impacts: | | | | | |
| | | At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system should be undertaken by the Contractor prior to the commencement of construction. | | | | | |
| | | The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. | | | | | |



EIA Ref. EM&A Ref.

Recommended Mitigation Measures

Objectives of the Recommended Measure & Main Concerns to address

Who to implement the measure?

Location of the measure

When to implement the measure?

What requirements or standards for the measure to achieve?

Temporary ditches should be provided to facilitate the runoff discharge into stormwater drainage system through a sediment/silt trap. The sediment/silt traps should be incorporated in the permanent drainage channels to enhance deposition rates, if practical.

- Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM standards under the WPCO. The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the Contractor prior to the commencement of construction.
- All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.
- Measures should be taken to minimize the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from foundation excavations should be discharged into storm drains via silt removal facilities.
- If surface excavation works cannot be avoided during the wet season (April to September), temporarily exposed slope/soil surfaces should be covered by tarpaulin or other means, as far as practicable, and temporary access roads should be protected by crushed stone or gravel, as excavation proceeds. Interception channels should be provided (e.g. along the crest/edge of the excavation) to prevent storm runoff from washing across exposed soil surfaces. Arrangements should always be in place to ensure that adequate surface protection measures can be safely carried out well before the arrival of a rainstorm. Other measures that need to be implemented before, during and after rainstorms are summarized in ProPECC Note PN 1/94.
- The overall slope of the site should be kept to a minimum to reduce



| EIA Ref. | EM&A | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement | Location of the | When to implement the | What requirements or standards for the |
|----------|------|---|--|------------------|--|-----------------------|--|
| | Ref. | | & Main Concerns to address | the measure? | measure | measure? | measure to achieve? |
| | | the erosive potential of surface water flows. | · | | | | |
| | | All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exit where practicable. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. | | | | | |
| | | Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system. | | | | | |
| | | Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and stormwater runoff being directed into foul sewers. | | | | | |
| | | ■ Precautions should be taken at any time of the year when rainstorms are likely. Actions should be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC Note PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes. | | | | | |
| | | ■ Bentonite slurries used in piling or slurry walling should be reconditioned and reused wherever practicable. Temporary enclosed storage locations should be provided on-site for any unused bentonite that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries. | | | | | |
| 5.6.1.1 | 4.1 | Good site practices for works within water gathering grounds | To minimize water | Contractor | Construction | Construction | ProPECC Note PN |
| | | The following conditions should be complied, if there is any works to be carried out within the water gathering grounds: | quality impacts to the water gathering grounds | | Works Sites within the water gathering | Phase | 1/94 |



Objectives of the What requirements Who to Recommended When to **Recommended Mitigation Measures** EM&A implement Location of the or standards for the Measure EIA Ref. implement the Ref. the measure measure to measure? & Main Concerns measure? achieve? to address grounds Adequate measures should be implemented to ensure no pollution

- or siltation occurs to the catchwaters and catchments.
- No earth, building materials, oil or fuel, soil, toxic materials or any materials that may possibly cause contamination to water gathering grounds are allowed to be stockpiled on site.
- All surplus spoil should be removed from water gathering grounds as soon as possible.
- Temporary drains with silt traps should be constructed at the site boundary before the commencement of any earthworks.
- Regular cleaning of silt traps should be carried out to ensure proper operation at all time.
- All excavated or filled surfaces which have the risk of erosion should always be protected form erosion.
- Facilities for washing the wheels of vehicles before leaving the site should be provided.
- Any construction plant which causes pollution to catchwaters or catchments due to the leakage of oil or fuel should be removed off site immediately.
- No maintenance activities which may generate chemical wastes should be undertaken in the water gathering grounds. Vehicle maintenance should be confined to designated paved areas only and any spillages should be cleared up immediately using absorbents and waste oils should be collected in designated tanks prior to disposal off site. All storm water run-off from these areas should be discharged via oil/petrol separators and sand/silt removal traps.
- Any soil contaminated with fuel leaked from plant should be removed off site and the voids arising from removal of contaminated soil should be replaced by suitable material approved by the Director of Water Supplies.
- Provision of temporary toilet facilities and use of chemicals or insecticide of any kind are subject to the approval of the Director of Water Supplies.
- Drainage plans should be submitted for approval by the Director of



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement the | Location of the measure | When to implement the measure? | What requirements or standards for the measure to |
|----------|--------------|---|---------------------------------------|----------------------|--|--------------------------------|--|
| | | | & Main Concerns to address | measure? | | measure? | achieve? |
| | | Water Supplies. | | | | | |
| | | An unimpeded access through the waterworks access road should always be maintained. | | | | | |
| | | Earthworks near catchwaters or streamcourses should only be carried out in dry season between October and March, | | | | | |
| | | Advance notice must be given before the commencement of works on site quoting WSD's approval letter reference. | | | | | |
| 5.6.1.2 | 4.1 | Good site practices of general construction activities | To minimize water | Contractor | All construction | Construction | EIA Recommendation |
| | | Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used. | quality impacts | | works sites | phase | |
| | | Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event. | | | | | |
| 5.6.1.3 | 4.1 | Sewage effluent from construction workforce | To minimize water | Contractor | All construction | Construction | EIA Recommendation |
| | | Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. | quality impacts | | works sites with on-site sanitary facilities | phase | and Water Pollution Control Ordinance (WPCO) |
| 5.6.1.4 | 4.1 | Hydrogeological Impact | To minimize water | Contractor | Construction | Construction | EIA Recommendation |
| | | Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site. | | | works sites of the drill and blast tunnel | phase | and WPCO |
| Water Qu | ality Impac | ct (Operation) | | | | | |
| | | No mitigation measure is required. | | | | | |



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement the | Location of the measure | When to implement the | What requirements or standards for the measure to | |
|----------|--------------|---|--|---|--|--|---|---|
| | no. | | & Main Concerns to address | measure? | measure | measure? | achieve? | |
| Sewage a | and Sewera | age Treatment Impact (Construction) | | | | | | |
| 6.7 | 5 | The sewage generated by the on-site workforce should be collected in chemical toilets and disposed of off-site by a licensed waste collector. | To minimize water quality impacts | Contractor | All construction works sites with on-site sanitary facilities | Construction phase | EIA recommendation and WPCO | |
| Sewage a | and Sewera | age Treatment Impact (Operation) | | | | | | |
| 6.6.3 | 5 | Sewage generated by the BCP and Chuk Yuen Village Resite will be collected and treated by the proposed on-site sewage treatment facility using Membrane Bioreactor treatment with a portion of the treated wastewater reused for irrigation and flushing within the BCP. | To minimize water quality impacts | DSD | BCP | Operation phase | EIA recommendation and WPCO | |
| 6.5.3 | 5 | Sewage generated from the Administration Building will be discharged to the existing local sewerage system. | To minimize water quality impacts | DSD | Administration Building | Operation phase | EIA recommendation and WPCO | |
| Waste Ma | anagement | Implication (Construction) | | | | | | |
| 7.6.1.1 | 6 | 6 | Good Site Practices Adverse impacts related to waste management such as potential hazard, air, odour, noise, wastewater discharge and public transport as mentioned in section 3.4.7.2 (ii)(c) of the Study Brief are not expected to arise, provided that good site practices are strictly followed. Recommendations for good site practices during the construction activities include: | To minimize adverse environmental impact | Contractor | Construction works sites (general) | Construction Phase | EIA recommendation; Waste Disposal Ordinance; Waste Disposal (Chemical Wastes) (General) Regulation; and ETWB TC(W) No. |
| | | Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site | | | | | 19/2005, Environmental Management on Construction Site | |
| | | Training of site personnel in proper waste management and chemical handling procedures | | | | | | |
| | | Provision of sufficient waste disposal points and regular collection of waste | | | | | | |
| | | Dust suppression measures as required under the Air Pollution Control (Construction Dust) Regulation should be followed as far as practicable. Appropriate measures to minimise windblown litter and dust/odour during transportation of waste by covering trucks or in enclosed containers | | | | | | |
| | | General refuse shall be removed away immediately for disposal. As | | | | | | |



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure & Main Concerns to address | Who to implement the measure? | Location of the measure | When to implement the measure? | What requirements or standards for the measure to achieve? |
|----------|--------------|---|--|-------------------------------|--------------------------|--------------------------------|--|
| | | such odour is not anticipated to be an issue to distant sensitive receivers | | | | | |
| | | Provision of wheel washing facilities before the trucks leaving the works area so as to minimise dust introduction from public road | | | | | |
| | | Covers and water spraying system should be provided for the stockpiled C&D material to prevent dust impact or being washed away | | | | | |
| | | Designate different locations for storage of C&D material to enhance reuse | | | | | |
| | | ■ Well planned programme for transportation of C&D material to lessen the off-site traffic impact. Well planned delivery programme for offsite disposal and imported filling material such that adverse noise impact from transporting of C&D material is not anticipated | | | | | |
| | | ■ Site practices outlined in ProPECC PN 1/94 "Construction Site Drainage" should be adopted as far as practicable, such as cleaning and maintenance of drainage systems regularly | | | | | |
| | | Provision of cover for the stockpile material, sand bag or earth bund as barrier to prevent material from washing away and entering the drains | | | | | |
| 7.6.1.2 | : | Waste Reduction Measures | To reduce the | Contractor | Construction | Construction | EIA recommendation |
| | | Good management and control can prevent the generation of a significant amount of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include: | quantity of wastes | | works sites (General) | Phase | and Waste Disposal Ordinance |
| | | Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal | | | | | |
| | | Encourage collection of aluminium cans by providing separate labelled bins to enable this waste to be segregated from other general refuse generated by the work force | | | | | |
| | | Proper storage and site practices to minimise the potential for damage or contamination of construction materials | | | | | |
| | | Plan and stock construction materials carefully to minimise amount | | | | | |



| EIA Ref. | EM&A Ref. | Recommended Mitigation Measures | Objectives of the Recommended Measure | Who to implement the | Location of the measure | When to implement the measure? | What requirements or standards for the measure to achieve? |
|----------|--------------|---|--|----------------------|--|--------------------------------|---|
| | nei. | | & Main Concerns to address | measure? | illeasure | | |
| | | of waste generated and avoid unnecessary generation of waste | | | | | |
| | | In addition to the above measures, specific mitigation measures are recommended below for the identified waste arising to minimise environmental impacts during handling, transportation and disposal of these wastes. | | | | | |
| 7.6.1.3 | 6 | C&D Materials | To minimize | Contractor | Construction | Construction | EIA recommendation; |
| | | In order to minimise impacts resulting from collection and transportation of C&D material for off-site disposal, the excavated materials should be reused on-site as backfilling material as far as practicable. The surplus rock and other inert C&D material would be disposed of at the Government's Public Fill Reception Facilities (PFRFs) at Tuen Mun Area 38 for beneficial use by other projects in the HKSAR as the last resort. C&D waste generated from general site clearance and tree felling works would require disposal to the designated landfill site. Other mitigation requirements are listed below: | impacts resulting from C&D material | | Works Sites (General) | Phase | Waste Disposal Ordinance; and ETWB TCW No. 31/2004 |
| | | A Waste Management Plan should be prepared and implemented in accordance with ETWB TC(W) No. 19/2005 Environmental Management on Construction Site; and | | | | | |
| | | ■ In order to monitor the disposal of C&D material and solid wastes at public filling facilities and landfills, and to control fly-tipping, a trip-ticket system (e.g. ETWB TCW No. 31/2004) should be included. | | | | | |
| 7.6.1.4 | 6 | General refuse General refuse should be stored in enclosed bins or compaction units separated from other C&D material. A reputable waste collector is to be employed by the Contractor to remove general refuse from the site separately. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' litter. | To minimize impacts resulting from collection and transportation of general refuse for off-site disposal | Contractor | Construction works sites (General) | Construction phase | Waste Disposal Ordinance and Public Health and Municipal Services Ordinance - Public Cleansing and Prevention of Nuisances Regulation |
| 7.6.1.5 | 6 | Chemical waste If chemical wastes are produced at the construction site, the Contractor will be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical | To minimize impacts resulting from collection and transportation of chemical waste for off-site disposal | Contractor | Construction works sites (General) | Construction phase | Waste Disposal (Chemical Waste) (General) Regulation and Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes |

Appendix N

Investigation Report for Exceedance



Fax Cover Sheet

To Mr. Daniel Ho **Fax No 2638 7077**

Company Chun Wo Construction Ltd

cc

From Nicola Hon Date 9 February 2017

Our Ref TCS00670/13/300/F0856 No of Pages 4 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report of Exceedance of Water Quality at Location WM4 on 21 January

2017 (Contract 3)

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Mr. Ho,

Further to the Notification of Exceedance (NOE) reference of the following.

TCS00670/13/300/F0844 dated 23 January 2017 TCS00670/13/300/F0855 dated 6 February 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at **Tel: 2959-6059 or Fax: 2959-6079**.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Mr. David Chan (EPD) Fax: 2685 1155

Mr. Desmond Lam (CE/BCP, NTEDO, CEDD/C3) Fax 3547 1659 Mr. Alan Lee (ER of C3, AECOM) Fax: 2171 3498 Mr. Antony Wong (IEC, SMEC) By e-mail



Agreement No. CE 45/2008 Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report on Action or Limit Level Non-compliance

| Project | | CE 45/2008 | | | |
|---------------|----------|--|-------------------------------------|--|--|
| Date | | 21 January 2017 | | | |
| Location | | WM4 | | | |
| Time | | 11:36 | | | |
| Parameter | | Turbidity (NTU) | Suspended Solids (mg/L) | | |
| Action Level | | 35.2 AND 120% of upstream | 39.4 AND 120% of upstream | | |
| Action Level | | control station of the same day | control station of the same day | | |
| Limit Level | | 38.4 AND 130% of upstream | 45.5 AND 130% of upstream | | |
| Limit Level | | control station of the same day | control station of the same day | | |
| Measured | WM4-CA | 6.8 | <2 | | |
| Level | WM4-CB | 12.8 | 10.0 | | |
| Level | WM4 | 73.3 | 126.5 | | |
| Exceedance | | Limit Level | Limit Level | | |
| Investigation | Results, | 1. According to the site information | on provided by the Contractor of | | |
| Recommendat | | | on activities carried out on 21 | | |
| Mitigation Me | asures | | ral site works such as excavation, | | |
| | | | mwork and concreting which as | | |
| | | same as the past months and the | ese activities would not generated | | |
| | | excessive wastewater. | | | |
| | | 2. According to the site record from the monitoring team on 21 | | | |
| | | January 2017, turbid water was observed at WM4 while the | | | |
| | | water quality at WM4-CA and WM4-CB was visually clear. | | | |
| | | (Photo 1 to 3 and Figure 1) | | | |
| | | 3. During weekly site inspection b | y ET on 18 and 23 January 2017, | | |
| | | | e wastewater was generated from | | |
| | | | and the water quality in the | | |
| | | | to the construction site was clear. | | |
| | | · · | dition was generally in order and | | |
| | | | ets and abnormal situation under | | |
| | | | Moreover, there was no rain | | |
| | | | and runoff from the site was | | |
| | | • | vestigation, it is considered that | | |
| | | | l variation and unlikely related to | | |
| | | the works under the Contract. | • | | |
| | | 4. According to the Event and Ac | tion, the monitoring frequency at | | |
| | | | ed to daily due to the limit level | | |
| | | | exceedances were triggered in | | |
| | | | the subsequent monitoring result, | | |
| | | | at WM4 on 23 and 24 January | | |
| | | | or should continue to implement | | |
| | | | n measures recommended in | | |
| | | implementation schedule in the | | | |
| • | | - | | | |

| Nicola Hon | | | |
|---------------------------------|--|--|--|
| Environmental Consultant | | | |
| Aul | | | |
| 9 February 2017 | | | |
| | | | |

Photo Record



Photo 1
Turbid water was observed at WM4 on 21 January 2017.



The water quality at WM4-CA was visually clear on 21 January 2017.



Photo 3
The water quality at WM4-CB was slightly turbid clear on 21 January 2017.



During weekly site inspection by ET in January 2017, it was observed that the water quality in the existing river channel adjacent to the construction site was clear.



During weekly site inspection by ET in January 2017, it was observed that no excessive wastewater was generated from the active construction works and the water quality in the existing river channel adjacent to the construction site was clear.

Contract No. CV/2012/09 俊和建築工程有限公司 Liantang / Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works - Contract 3 Chun Wo Construction & Engineering Co., Ltd. EXISTING FOOTBRIDGE TO BE ____ KAU LUNG HANG VEHICULAR BRIDGE TO BE CONSTRUCTED BY OTHERS EXISTING SECTION OF FOOTBRIDGE
ABOVE MTR EAST AND LAINE TO BE
RETAINED

Figure 1. Location of Water Quality Monitoring Location





To Mr. Roger Lee Fax No 2717 3299

Company Dragages Hong Kong Limited

 \mathbf{cc}

From Nicola Hon Date 9 February 2017

Our Ref TCS00697/13/300/F0857 No of Pages 4 (Incl. cover sheet)

RE Agreement No. CE 45/2008

Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works

Investigation Report of Exceedance of Water Quality at Location WM4 on 21 January

2017 (Contract 2)

If you do not receive all pages, or transmission is illegible, please contact the originator on (852) 2959-6059 to re-send. Should this facsimile be sent to the wrong fax number, would receiver please destroy this copy and notify Action-United Environmental Services & Consulting immediately. Thank you.

Dear Mr. Lee,

Further to the Notification of Exceedance (NOE) reference of the following.

TCS00670/13/300/F0845 dated 23 January 2017 TCS00670/13/300/F0856 dated 6 February 2017

Please find attached the "Investigation Report on Action or Limit Level Non-compliance" referenced above for your follow up action.

Should you have any queries or need further information, please do not hesitate to contact us or the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours Faithfully, For and on Behalf of

Action-United Environmental Services & Consulting

Nicola Hon

Environmental Consultant

Encl.

c.c. Mr. David Chan (EPD) Fax: 2685 1155 Mr. B.K. Chow (CE/BCP, NTWDO, CEDD/C2) Fax: 3547 1659

> Mr. CT Wong (PER, AECOM) Fax: 2171 3498 Mr. Antony Wong (IEC, SMEC) By e-mail



Agreement No. CE 45/2008 Liantang/ Heung Yuen Wai Boundary Control Point and Associated Works Investigation Report on Action or Limit Level Non-compliance

| Project | | CF | E 45/2008 | | |
|--|--------|---|-----------------------------------|--|--|
| Date | | 21 January 2017 | | | |
| Location | | WM4 | | | |
| Time | | 11:36 | | | |
| Parameter | | Turbidity (NTU) | Suspended Solids (mg/L) | | |
| Action Level | | 35.2 AND 120% of upstream | 39.4 AND 120% of upstream control | | |
| | | control station of the same day | station of the same day | | |
| Limit Level | | 38.4 AND 130% of upstream | 45.5 AND 130% of upstream control | | |
| | | control station of the same day | station of the same day | | |
| Measured | WM4-CA | 6.8 | <2 | | |
| Level | WM4-CB | 12.8 | 10.0 | | |
| Level | WM4 | 73.3 | 126.5 | | |
| Exceedance | | Limit Level | Limit Level | | |
| Investigation Results, Recommendations & Mitigation Measures | | According to the site information provided by the Contractor of Contract 2 (DHK), construction activities carried out at South Portal during 21 January 2017 included tunnel excavation and construction of ventilation building. According to the site record from the monitoring team on 21 January 2017, turbid water was observed at WM4 while the water quality at WM4-CA and WM4-CB was visually clear. (<i>Photo 1 to 3 and Figure 1</i>) During weekly site inspection at South Portal by ET in January 2017, it was observed the wastewater treatment facility implemented on site was function properly and the treated water to be discharge was visually clear. (<i>Photo 4</i>) The site condition was generally in order and no adverse water quality impacts and abnormal situation under the Contract were identified. Moreover, there was no rain recorded on 21 January 2017 and runoff from the site was unlikely to occur. In our investigation, it is considered that exceedances were due to natural variation and unlikely related to the works under the Contract. According to the Event and Action, the monitoring frequency at exceed station shall be increased to daily due to the limit level exceedance recorded until no exceedances were triggered in consecutive days. In view of the subsequent monitoring result, no exceedances were triggered at WM4 on 23 and 24 January 2017. However, the Contractor should continue to implement the environmental mitigation measures recommended in implementation | | | |

| Prepared By: _ | Nicola Hon | | |
|----------------|--------------------------|--|--|
| Designation : | Environmental Consultant | | |
| Signature : | Aula | | |
| Date : | 9 February 2017 | | |



Photo Record



Photo 1
Turbid water was observed at WM4 on 21 January 2017.



Photo 2
The water quality at WM4-CA was visually clear on 21 January 2017.



Photo 3
The water quality at WM4-CB was slightly turbid clear on 21 January 2017.



Photo 4
During weekly site inspection at South Portal by ET in January 2017, it was observed the wastewater treatment facility implemented on site was function properly and the treated water to be discharge was visually clear.

Contract No. CV/2012/09 Liantang / Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works - Contract 3



俊和建築工程有限公司 Chun Wo Construction & Engineering Co., Ltd.

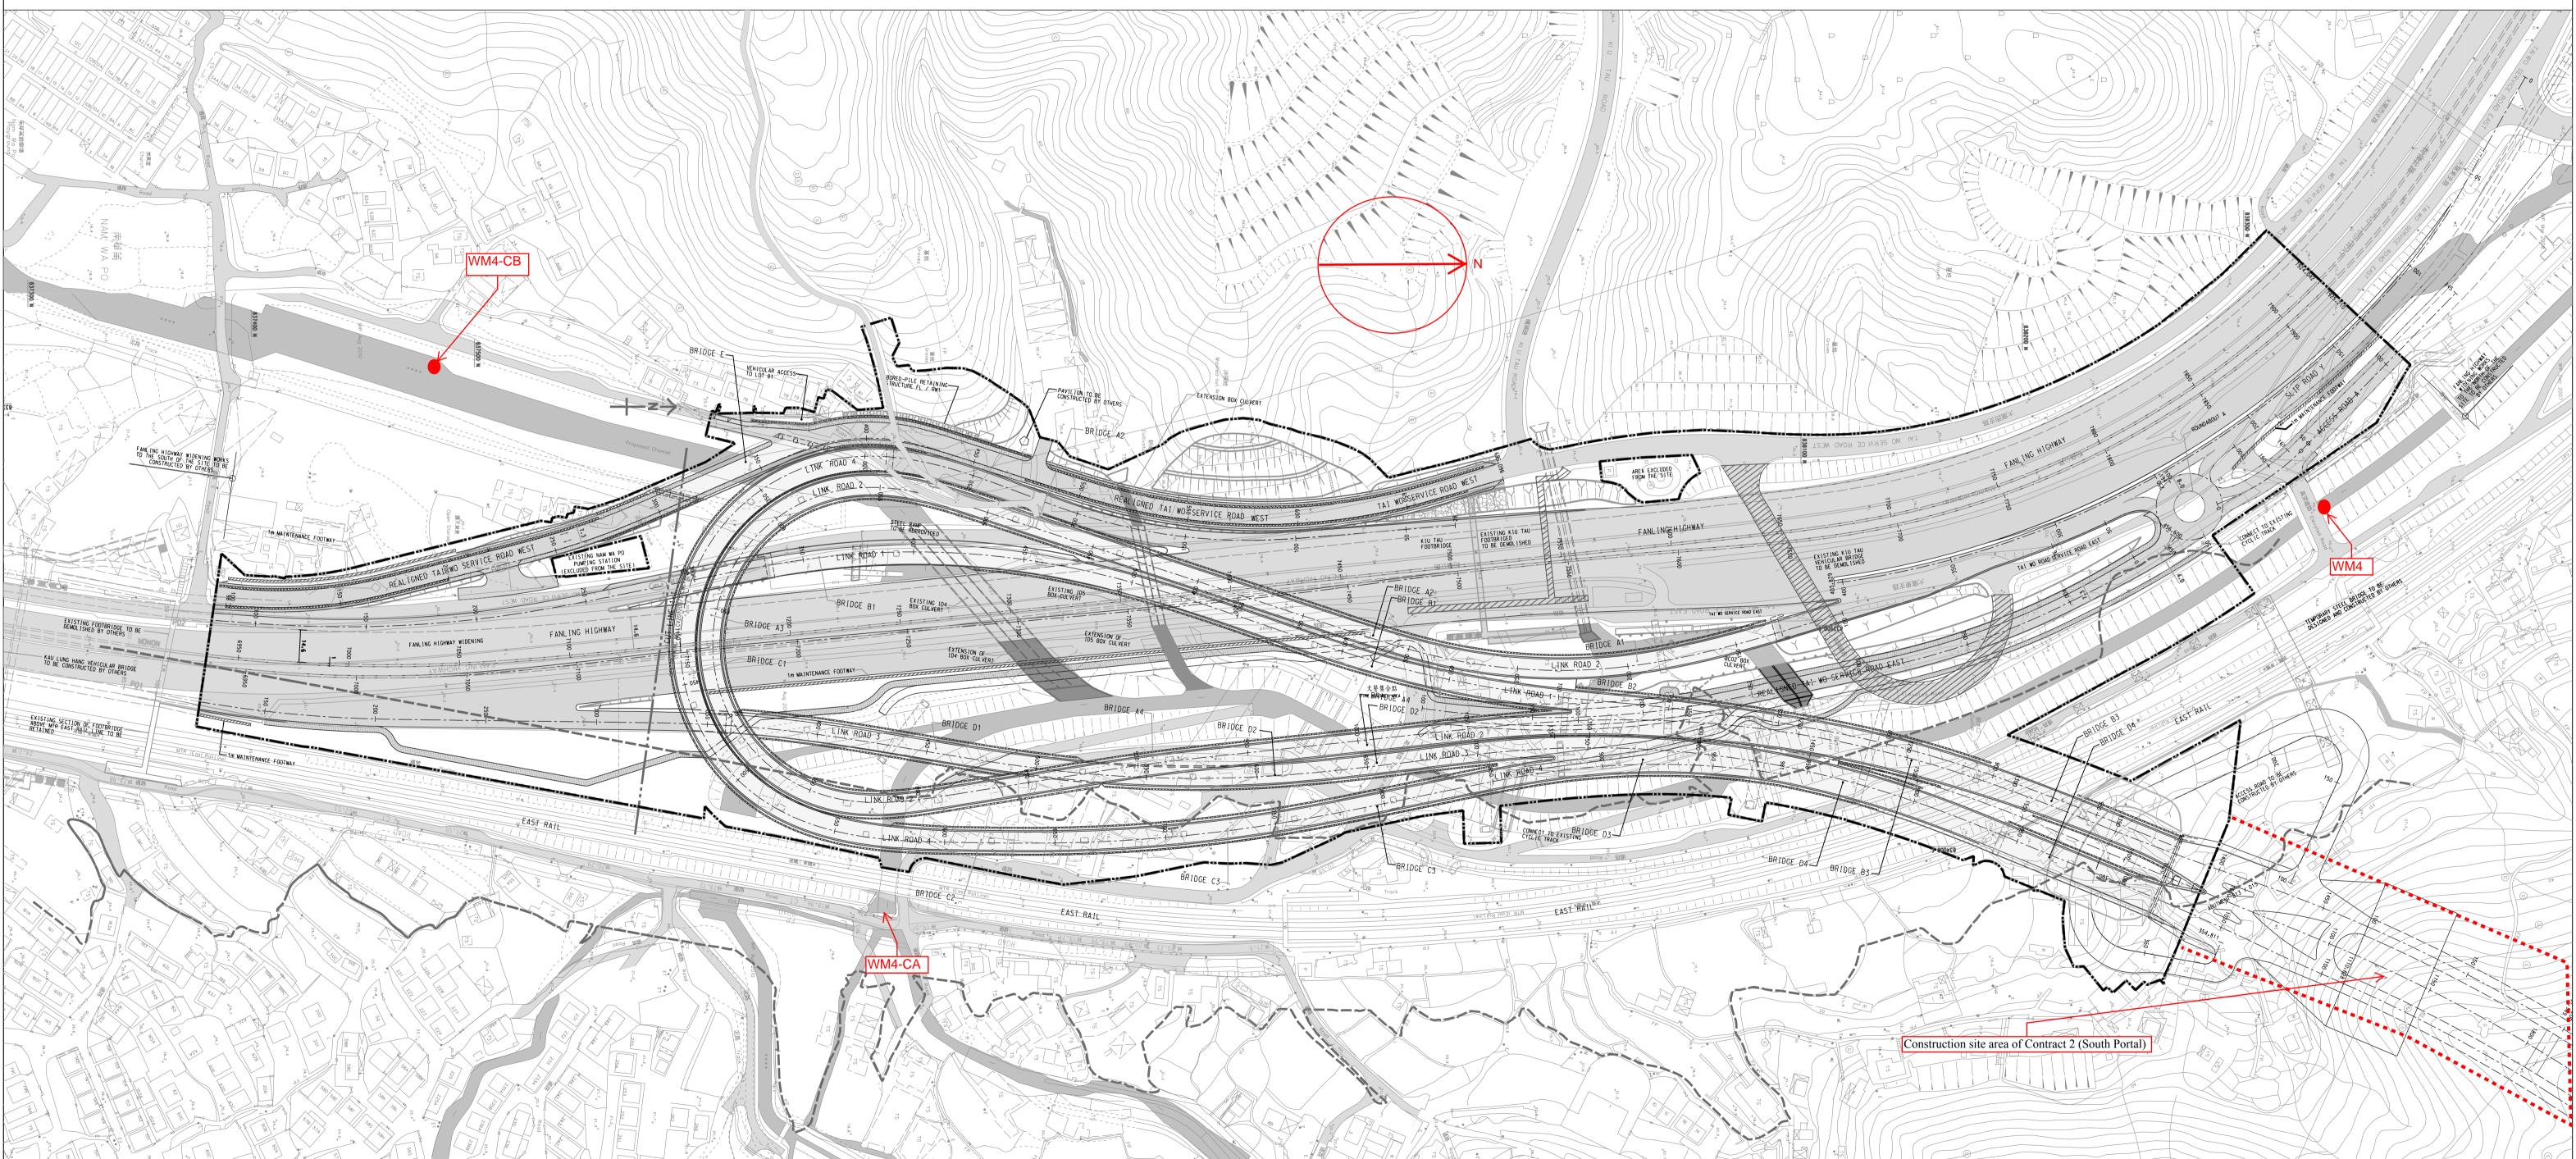


Figure 1. Location of Water Quality Monitoring Location