

# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



# China Harbour – Zhen Hua Joint Venture

# Contract No.: CV/2015/07 Handling of Surplus Public Fill (2016-2018)

TSEUNG KWAN O AREA 137 FILL BANK

MONTHLY EM&A REPORT NO.25

(MAY 2019)

Prepared by:

TANG, Chung Hang Environmental Officer

Checked by:

LĂU, Chi Leung Environmental Team Leader

Issue Date: 05 June 2019

Report No.: ENA94329

This report shall not be reproduced unless with prior written approval from this laboratory.



## Ref.: CEDPFRSFEM02 0 0635L.19

18 June 2019

By Email and Fax No.: 2695 3944

**ETS-Testconsult Limited** 8/F, Block B, Veristrong Industrial Centre 34-36 Au Pui Wan Street Fo Tan, Hong Kong

Attention: Mr. C L Lau

Dear Mr. Lau,

#### Re: Contract No. CV/2015/07 Handling of Surplus Public Fill (2016 – 2018)

# Monthly EM&A Report (No. 25) for May 2019 for the Tseung Kwan O Area 137 Fill Bank

Reference is made to your submission of the draft Monthly EM&A Report for May 2019 for the TKO Area 137 Fill Bank received by email on 10 June 2019 and the subsequent revision on 17 June 2019.

We are pleased to inform you that we have no further comment on the captioned report.

Thank you for your attention. Please do not hesitate to contact our Jason Lai or the undersigned should you have any queries.

Yours sincerely, For and on behalf of Ramboll Hong Kong Limited

Use Frankle

F. C. Tsang Independent Environmental Checker

c.c. CEDD

Attn: Ms. Lisa Yung Attn: Mr. S W Suna CHZHJV

.

Fax No.: 2714 0113 By Email

Q:\Projects\CEDPFRSFEM02\02 Project Management\02 Corr\CEDPFRSFEM02\_0\_0635L.19.doc



ENA94329 Monthly EM&A Report No.25

#### TABLE OF CONTENTS

TABLE OF CO	DNTENTS	Page	
EXECUTIVE S	SUMMARY		
1.0	INTRODUCTION		1
2.0	PROJECT INFORMATION		
	2.1 Scope of the Project		1
	2.2 Site Description		1
	2.3 Work Programme		2
	2.4 Project Organization and Management Structure 2.5 Contact Details of Key Personnel		2 2
3.0	WORK PROGRESS IN THIS REPORTING PERIOD		2
4.0	AIR QUALITY MONITORING		2
410	4.1 Monitoring Requirement		2
	4.2 Monitoring Equipment		2
	4.3 Monitoring Parameters, Frequency and Duration		2
	4.4 Monitoring Locations and Schedule		3
	4.5 Monitoring Methodology		3
	4.6 Action and Limit levels		3-4
	4.7 Event-Action Plans 4.8 Results and Observation		4 4
5.0	A.O Results and Observation NOISE MONITORING		4
0.0	5.1 Monitoring Requirements		4
	5.2 Monitoring Equipment		4
	5.3 Monitoring Parameters, Duration and Frequency		4-5
	5.4 Monitoring Locations		5
	5.5 Monitoring Procedures and Calibration Details		5
	5.6 Action and Limit levels		5
	5.7 Event-Action Plans 5.8 Results and Observation		5 5-6
6.0	MARINE WATER QUALITY MONITORING		5-0
0.0	6.1 Monitoring Requirements		6
	6.2 Monitoring Locations		6
	6.3 Monitoring Parameters		6-7
	6.4 Monitoring Frequency		7
	6.5 Monitoring Methodology and Equipment Used		7 - 8
	6.6 Action and Limit Level 6.7 Event and Action Plan		9
	6.8 Monitoring Duration in this reporting period		9 9
	6.9 Marine Water Monitoring Results		10
7.0	ENVIRONMENTAL AUDIT		
	7.1 Weekly ET Site Inspections and EPD's Site Inspection		10-11
	7.2 Review of Environmental Monitoring Procedures		11
	7.3 Assessment of Environmental Monitoring Results		11
	7.4 Advice on the Solid and Liquid Waste Management Status		11 -12 12-13
8.0 9.0	STATUS OF ENVIRONMENTAL LICENSING AND PERMITTING ENVIRONMENATL NON-CONFORMANCE		12-13
5.0	9.1 Summary of air quality, noise and marine water quality		13
	9.2 Summary of Environmental Complaints		13
	9.3 Summary of Notification of Summons and Prosecution		13
10.0	IMPLEMENTATION STATUS		
	10.1 Implementation Status of Environmental Mitigation Measures		13
	10.2 Implementation Status of Event and Action Plan		13
	10.3 Implementation Status of Environmental Complaint, Notifications of Summons and	nd	13
	Successful Prosecutions Handling		40.44
11.0	CONCLUSION AND RECOMMENTATIONS		13-14
12.0			45
	12.1 Work Programme for the Coming Month		15
	12.2 Key Issues for the Coming Month 12.3 Monitoring Schedule for the Coming Month		15-16 16
			10



東業德勤測試顧問有限公司

APPENDIX

- A Organization Chart and Lines of Communication
- B1 Calibration Certificates for Impact Air Quality Monitoring Equipment
- B2 Impact Air Quality Monitoring Results
- B3 Graphical Plots of Impact Air Quality Monitoring Data
- C1 Calibration Certificates for Impact Noise Monitoring Equipment
- C2 Impact Noise Monitoring Results
- C3 Graphical Plots of Impact Noise Monitoring Data
- D1 Calibration Certificates for Impact Marine Water Quality Monitoring Equipment
- D2 Impact Marine Water Quality Monitoring Results
- D3 Graphical Plots of Impact Marine Water Quality Monitoring Data
- D4 Impact Marine Water Quality Monitoring Results (3RS project)
- D5 Graphical Plots of Impact Marine Water Quality Monitoring Data (3RS project)
- E Weather Condition
- F Event-Action Plans
- G Work Programme
- H Weekly ET's Site Inspection Record
- I Implementation Schedule of Mitigation Measures
- J Site General Layout Plan
- K Monitoring Schedule for the Coming Month
- L Complaint Log

#### FIGURES

- Figure 1 Locations of Water Quality Monitoring Stations Tseung Kwan O Area 137 Fill Bank
- Figure 2 Location of Noise Monitoring Station Tseung Kwan O Area 137 Fill Bank
- Figure 3 Locations of Air Quality Monitoring Stations Tseung Kwan O Area 137 Fill Bank
- Figure 4 Locations of Water Quality Monitoring Stations (3RS project) Tseung Kwan O Area 137 Fill

#### TABLES

- 2.1 Contact Details of Key Personnel
- 4.1 Air Quality Monitoring Equipment
- 4.2 Monitoring parameters, duration and frequency of air quality monitoring
- 4.3 Air Quality Monitoring Locations
- 4.4 Action and Limit levels for 24-hr TSP and 1-hr TSP
- 5.1 Noise Monitoring Equipment
- 5.2 Duration, Frequency and Parameters of noise monitoring
- 5.3 Noise Monitoring Location
- 5.4 Action and Limit levels for noise monitoring
- 6.1 Locations of Marine Water Monitoring Stations
- 6.2 Locations of Additional Marine Water Monitoring Stations (3RS project)
- 6.3 Marine Water Quality Monitoring Parameters
- 6.4 Monitoring frequency of the marine water
- 6.5 Summary of testing procedures
- 6.6 Details of Marine Water Quality Monitoring Equipment (In-site measurement)
- 6.7 Water Quality Action and Limit Levels
- 6.8 Water Quality Action and Limit Levels (3RS project)
- 6.9 Time Schedule of Impact Marine Water Quality Monitoring
- 6.10 Summary of Impact Marine Water Quality Exceedances
- 6.11 Summary of Impact Marine Water Quality Exceedances (3RS project)
- 7.1 Key Findings of Weekly ET Site Audits in this reporting period
- 7.2 Actual amounts of Waste generated in this reporting period
- 8.1 Summary of environmental licensing and permit status
- 10.1 Summary of Environmental Complaints and Prosecutions

ENA94329 Monthly EM&A Report No.25

東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

## EXECUTIVE SUMMARY

This monthly Environmental Monitoring and Audit (EM&A) report No.25 was prepared by ETS-Testconsult Ltd (ET) for "Contract No: CV/2015/07 – Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O (TKO) Area 137 Fill Bank" (The Project).

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at TKO Area 137 in May 2019.

#### Site Activities

As informed by the Contractor, the site activities in this reporting period were as below:

- 1.Operation of the TKO137 Fill Bank.
- 2.Delivery of public fill to Taishan;
- 3. Operation of dewatering plant and expanded dewatering plant
- 4. Operation of bentonite pool.
- 5. Concrete block breaking work.
- 6. Crushing plant operation.
- 7.Carrying out defects of Removal of public fill at Portion A6
- 8. Provision of photoelectric height limits warning system at the existing height restriction gantries;
- 9.Re-construction of sampling platforms at TKOFB;
- 10.Break up of concrete pavement at Portion A5c at TKOFB;
- 11. Replacement of Y40 rebar with Y50 rebar at the existing wheel washing bay at TKOFB;
- 12. Enhancement Rainwater Collection and Recycling Facility at TKOFB
- 13. Construction of concrete pavement at expanded dewatering plant
- 14. Repair works for damaged at TKOFB caused by Super Typhoon
- 15. Installation of LED Display Board;
- 16. Installation of Temporary Accommodation to CEDD Site Staff at TKOFB;
- 17. Carry out preliminary sorting on Public Fill for 3RS project

#### Environmental Monitoring Progress

The summary of the monitoring activities in this monitoring period is listed below:

- Noise Monitoring (Day-time): 1 Occasion at 1 designated location
- 24-hour TSP Monitoring: 5 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 16 Occasions at 2 designated locations
- Marine Water Quality Monitoring: 14 Occasions at 2 designated locations
- Weekly-site inspection: 4 Occasions

#### Noise Monitoring

No exceedance of Action and Limit levels for noise monitoring was recorded in the reporting period.

#### Air Monitoring

No exceedance of Action and Limit levels was recorded for 1-hr and 24-hr TSP monitoring in the reporting period.

#### Marine Water Quality Monitoring

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded in this reporting period.

#### Weekly Site Inspections

In general, performance on environmental mitigation measures implemented was found to be satisfactory in this reporting period. The major findings observed during site inspections are presented in the Section 7.0.

#### Environmental Complaints, Notification of summons and successful prosecutions

One complaint received on 14 May 2019, no notification of summons or successful prosecutions with respect to environmental issues was received in this reporting period.

#### Future Key Issues

Based on site inspections and forecast of engineering works in coming month, key issues to be considered are as follows:

- Noise and air quality impact due to site works;
- Maintain wheel washing facilities properly;
- Maintain all drainage and desilting facilities properly;
- Use and maintain silt curtain properly;
- Clean up the fill material on concrete pavement along the BHA frequently;



Monthly EM&A Report No.25

- Sufficient drip trays for all oil drums / chemical containers;
- Implement all necessary preventive measures to avoid oil leakage. In the event an oil leakage happens, the Contractor should properly remove the leaked oil and handle the contaminated soil and all materials using for this cleaning works as chemical waste;
- Maintain good site practice and waste management to minimize environmental impacts at the site; and
- Follow-up improvements on waste management issues.

#### 1.0 INTRODUCTION

*China Harbour – Zhen Hua Joint Ve*nture (CHZH-JV) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit (EM&A) for the "Contract No: CV/2015/07 –Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O (TKO) Area 137 Fill Bank" (The Project).

In accordance with the Environmental Permit (No.: EP-134/2002/M) (the EP), an EM&A programme should be implemented in accordance with the procedures and requirements in the EM&A Manual of the approved EIA report (Registration No. AEIAR-060/2002). The EM&A programme for this study as stated in Section 2.3.1 of the EM&A Manual covers the following environmental aspects during the establishment, operation and removal phases of the Fill Bank at Tseung Kwan O Area 137:

- Fugitive Dust;
- Noise generation from onsite activities;
- Water Quality; and
- Landscape and Visual.

The EM&A programme requires environmental monitoring for air quality, noise and water quality and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:

- All monitoring parameters;
- Monitoring schedules for the reporting period and forthcoming months;
- Action and Limit levels for all environmental parameters;
- Event/Action Plans;
- Environmental mitigation measures, as recommended in the Project EIA study final report; and
- Environmental requirements in contract documents.

Baseline monitoring was completed in August and October 2002 by MateriaLab. Action and Limit Levels were established for air and water quality parameters based on the baseline monitoring results.

This report documented the findings of EM&A Works conducted during the operation phase of Fill Bank at Tseung Kwan O Area 137 in May 2019.

### 2.0 PROJECT INFORMATION

#### 2.1 Scope of the Project

The scale and scope of the Project as stated in the EP include:

- Site clearance;
- Construction of a temporary storm water system;
- Stockpiling of 6 million m<sup>3</sup> of public fill;
- Setting up two barging points: one at the TKO Basin and one at the Construction and Demolition Material Sorting Facility (C&DMSF) for transporting the stockpiled public fill by barges;
- Setting up a temporary barging point at the existing Explosive Off-loading Barging Point located in the south-eastern part of Area 137 for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge;
- Construction and operation of a Construction and Demolition Material Sorting Facility (C&DMSF);
- Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin; and
- Remove the temporary fill bank.

#### 2.2 Site Description

TKO Area 137 Fill Bank is located at the southern end of Wan Po Road. In the vicinity of the site are other industrial uses such as SENT landfill, TKO Industrial Estate, etc. Both Island Resort and Fullview Garden are also situated at more than 1.8km from the site. Other existing ASRs and NSRs, including resident developments and schools, are located at a further distance away from TKO Area 137.



#### 2.3 Work Programme

Details of work programme are shown in Appendix G.

#### 2.4 Project Organization and Management Structure

The project organization chart is shown in Appendix A.

#### 2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers are shown in Table 2.1.

#### Table 2.1 Contact Details of Key Personnel

	betallo of reginerous			
Organization	Name of Key Staff	Project Role	Tel. No.	Fax No.
CEDD	Lisa Yung, Norelle Li May Lau, James Sze, Phoebe Tang	Engineer's Representative	2762 5555	2714 0113
IEC (Ramboll)	F C Tsang	IEC	3465 2888	3465 2899
Contractor (CHZH-JV))	Zhou Chang Ying	Project Director	96266299	22474108
ET (ETL)	C. L. Lau	ET Leader	2946 7791	2695 3944

### 3.0 WORK PROGRESS IN THIS REPORTING PERIOD

As informed by the Contractor, the activities in the reporting period include:

1. Operation of the TKO137 Fill Bank.

2. Delivery of public fill to Taishan;

3. Operation of dewatering plant and expanded dewatering plant

4. Operation of bentonite pool.

5. Concrete block breaking work.

6. Crushing plant operation.

7.Carrying out defects of Removal of public fill at Portion A6

8. Provision of photoelectric height limits warning system at the existing height restriction gantries;

9.Re-construction of sampling platforms at TKOFB;

10. Break up of concrete pavement at Portion A5c at TKOFB;

11.Replacement of Y40 rebar with Y50 rebar at the existing wheel washing bay at TKOFB;

12. Enhancement Rainwater Collection and Recycling Facility at TKOFB

13. Construction of concrete pavement at expanded dewatering plant

14. Repair works for damaged at TKOFB caused by Super Typhoon

15.Installation of LED Display Board;

16.Installation of Temporary Accommodation to CEDD Site Staff at TKOFB;

17.Carry out preliminary sorting on Public Fill for 3RS project

### 4.0 AIR QUALITY MONITORING

#### 4.1 Monitoring Requirement

TSP levels were monitored in the reporting period in accordance with the EM&A Manual. Table 4.4 shows the Action and Limit Levels for the environmental monitoring works.

## 4.2 Monitoring Equipment

Both 1-hour and 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificates for the HVS and calibrator are attached in Appendix B1.

#### Table 4.1Air Quality Monitoring Equipment

Equipment	Model and Make	
HVS	Greasby GMWS2310	
Calibrator	Tisch TE-5025A	

### 4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2	Monitoring parameters,	duration, frequenc	y of air quali	ty monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr	Once every six days
1-hr TSP	1-hr TSP 1 hr Three times per day every six of	

#### 4.4 Monitoring Locations

Table 4.3 tabulates the air quality monitoring locations of this project.

	Table 4.3	Air quality	monitoring	locations
--	-----------	-------------	------------	-----------

Monitoring station	Location
TKO-A1	Site Egress
TKO-A2a	CREO

#### 4.5 Monitoring Methodology

#### Both 1-hr and 24-hr air quality monitoring (High Volume Sampler)

#### Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets were employed for both 1-hour and 24-hour TSP monitoring. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

#### **Installation**

The installation of HVS refers to the requirement stated in EM&A Manual.

#### Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

- Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 0.6m<sup>3</sup>/min and 1.7m<sup>3</sup>/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50. The flow rate was indicated on the flow rate chart.
- For TSP sampling, fiberglass filters (Whatman G653) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling month of 1 hour or 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recoded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of 25°C <u>+</u> 3°C and the relative humidity (RH) <50% <u>+</u>5%.
- All measurement procedures in Section 2.3 of the EM&A Manual were followed during the reporting period.

Monthly EM&A Report No.25

東業德勤測試顧問有限公司

#### Maintenance & Calibration

- HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

#### Wind Data Monitoring

Wind data (wind speed and wind direction) were directly extracted from Tseung Kwan O Station of Hong Kong Observatory. All wind data during this reporting period are shown in Appendix E.

#### 4.6 Action and Limit Levels

Table 4.4 shows the Action and Limit levels for 24-hr TSP and 1-hr TSP monitoring.

Monitoring Logotion	24-hr TS	Ρ (μg/m³)	1-hr TSF	Ρ (μg/m³)
Monitoring Location	Action Level	Limit Level	Action Level	Limit Level
TKO-A1	210	260	376	500
TKO-A2a *	210	260	376	500

Table 4.4Action and Limit Levels for 24-hr TSP and 1-hr TSP

Remark (\*): Since dust monitoring stations TKO-A2 and TKO-A2a are located close to the major dust emission sources and also close to the same sensitive receptor and no significant difference between them on the prevailing meteorological conditions, the baseline data from TKO-A2 (August and September 2002 by MateriaLab) can also be valid in the case of TKO-A2a.

#### 4.7 Event-Action Plans

Please refer to Appendix F for details.

#### 4.8 Results and Observation

#### 4.8.1 1-hour and 24-hour TSP Monitoring results

Monitoring data of both 1-hour and 24-hour TSP monitoring carried out in this reporting period are summarized in Appendix B2. Graphical presentation of 1-hour and 24-hour TSP monitoring results for the reporting period is shown in Appendix B3. Wind data included wind speed and wind direction was extracted from Tseung Kwan O Station of Hong Kong Observatory during this reporting period and is presented in Appendix E.

No exceedance of Action and Limit Level of 1-hr TSP and 24-hour TSP monitoring results was recorded during the reporting period.

#### 4.8.2 Observation

Generally, the Contractor implemented sufficient dust mitigation measures, including operation of the mist spraying systems at the CEDD Combined Reception Office and the site egress area, wheel washing facilities, road dampening by water bowsers and automatic water sprinklers on the main haul roads. Other dust sources near TKO Area 137 also included operation of the temporary CWSF and dumping activities at the SENT Landfill.

#### 5.0 Noise Monitoring

#### 5.1 Monitoring Requirements

Noise monitoring was conducted at 1 monitoring station as specified in the approved EM&A Monitoring Proposal for good site practice. The equipment, parameter, frequency, duration, methodology, calibration details, results and observations of the noise monitoring for the reporting period are presented in this section.

#### 5.2 Monitoring Equipment

An Integrating Sound Level Meter was used for noise monitoring. It was a Type 1 sound level meter capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level ( $L_{eq}$ ) and percentile sound pressure level (Lx). It complies with International



ENA94329 Monthly EM&A Report No.25

Electro Technical Commission Publications IEC 61672 Type 1 specification, and speed in m/s was used to monitor the wind speed.

Table 5.1 summarizes noise monitoring equipment model being used. A copy of the calibration certificate for noise meter and calibrator are attached in Appendix C1

Table 5.1	Noise Monitoring	Equipment
1 4010 0.1	rioloo mornioring	Equipritorit

Equipment	Model	
Sound Level Meter	Rion NL-31 / Rion NL-52	
Sound Level Calibrator	Rion NC-73 / Castle GA607	

### 5.3 Monitoring Parameters, Duration and Frequency

Duration, frequencies and parameters of noise measurement are presented in Table 5.2.

#### Table 5.2 Duration, Frequencies and Parameters of Noise Monitoring

Time	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	L <sub>eq</sub> , L <sub>10</sub> , L <sub>90</sub>	Once per month

#### 5.4 Monitoring Locations

One Noise monitoring was conducted at the noise monitoring location, TKO-N1 as shown in Figure 2 during the reporting period. Table 5.3 describes the location of the monitoring station.

Table 5.3Noise Monitoring Location

Monitoring station	Location	Type of Measurement
TKO-N1	Outside site Egress along Wan Po Road	Free Field

#### 5.5 Monitoring Procedures and Calibration Details

**Operation/Analysis Procedures** 

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - Frequency weighting: A
  - Time weighting : Fast
  - Time measurement : 30 mins
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

#### Maintenance and Calibration

- The microphone head of the sound level meter and calibrator are cleaned with soft cloth in quarterly intervals.
- The meter is sent to the supplier or HOKLAS laboratory to check and calibrated in yearly intervals.

#### 5.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 5.4.

Table 5.4Action and Limit Levels for noise monitoring



Contract No.: CV/2015/07 Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O Area 137 Fill Bank ENA94329 Monthly EM&A Report No.25

Time Period	Action	Limit
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)

#### 5.7 Event-Action Plans

Please refer to the Appendix F for details.

#### 5.8 Results and Observation

#### 5.8.1 Results

Only Day-time noise monitoring was carried out at monitoring station TKO-N1 in this reporting period. The detail of the noise monitoring is provided in Appendix C2. Graphical presentation of the monitoring result for the reporting period is shown in Appendix C3. Since no documented complaints on noise issue were received in this reporting period, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

#### 5.8.2 Observation

The major noise source during the monitoring event was the dump truck traffic.

#### 6.0 MARINE WATER QUALITY MONITORING

#### 6.1 Monitoring Requirements

In accordance with the EM&A Manual, impact marine water quality monitoring was conducted three days per week. Measurements were taken at both mid-flood and mid-ebb tides at three depths (i.e. 1m below surface, mid depth and 1m from seabed) at Control Station, C1 and Monitoring Station, M4.

#### 6.2 Monitoring Locations

For the Reclamation Project, there were 4 Designated Monitoring Stations and 2 Designated Control Stations specified in the EM&A Manual. Upon the completion of the monitoring programme under Stage 2 reclamation works, the ET started monitoring events at the impact station M4 and the control station C1 from 18 May 2004 onwards.

Figure 1 shows the location of the marine water quality monitoring stations. Table 6.1 describes the locations of the monitoring stations in the reporting period.

Station Description	Code	HK Metric Grid E	HK Metric Grid N
Control Station (Ebb tide)	TKO-C1	844 740.208	815 371.502
Monitoring Station, Tung Lung Chau Fish Culture Zone	TKO-M4	847 741.029	812 977.878

 Table 6.1
 Locations of Marine Water Monitoring Stations

According to Environmental Permit (Permit no.:EP-134/2002/M) Condition 3.2, water quality survey/monitoring shall be conducted at control station C1a, monitoring stations M4a and M5 for the period from two weeks before commencement of operation of the additional 5 barging points to 4 weeks after cessation of their operation. The water quality survey/monitoring frequency and parameters at stations C1a, M4a and M5 shall be same as the requirements set out in the EM&A Manual and the monitoring results shall be incorporated in the monthly EM&A reports.

Due to "Hong Kong International Airport, Three Runway System Project Contract 3206 – Main Reclamation Works "(3RS project) operation of the additional barging point at TKO Area 137, the ET started monitoring events at the impact station M4a, M5 and the control station C1a from 14 May 2018 onwards.

Figure 4 shows the location of water control station C1a and water monitoring station M4a and M5.

Table 6.2 describes the locations of the additional marine water monitoring stations



Table 6.2         Locations of Additional Marine Water Monitoring Stations (3RS project)
--

Station Description	Code	HK Metric Grid E	HK Metric Grid N
Control Station (Ebb tide)	C1a	845647	814146
lease of Marilarian Ofation	M4a	845922	813973
Impact Monitoring Station	M5	847005	813678

### 6.3 Monitoring Parameters

Monitoring of the marine water quality parameters are listed in Table 6.3.

Table 6.3	Marine Water Quality Monito	ring Parameters
		ning i arameters

In-situ measurement	Laboratory analysis
Depth (m)	Suspended solids (mg/L)
Temperature ( $^{\circ}$ C)	
Dissolved Oxygen (mg/L and % saturation)	
Turbidity (NTU)	
Salinity (ppt)	

#### 6.4 Monitoring Frequency

The monitoring frequency of the marine water monitoring is summarized in Table 6.4.

#### Table 6.4Monitoring frequency of the marine water

Table et Homening heq			
Parameter	Frequency	No. of Location	No. of Depths
Temperature		2	
Salinity		(TKO-C1 and TKO-	3
DO	3 days/week,	M4)	(Surface, mid-depth
Turbidity	2 tides/day	and 3	& bottom)
Suspended solids		(C1a, M4a and M5)	

### 6.5 Monitoring Methodology and Equipment Used

#### For Location of the monitoring stations

#### **Global Positing System (GPS)**

A hand-held digital GPS was used to identify the designated monitoring stations prior to water sampling.

#### For Water Depth measurement

Echo Sounder

A portable, battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.

### For In-situ Water Quality Measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use, and subsequently recalibrated at 3 monthly intervals or sometimes longer throughout all stages of the water quality monitoring.

#### **Dissolved Oxygen, Salinity and Temperature Measuring Equipment**

A portable, weatherproof dissolved oxygen & salinity measuring instrument, which complete with cable, sensor and DC power source (e.g. YSI 85 or equivalent) was used for measuring:

- a dissolved oxygen level in the range of 0-20 mg/L and 0-200 % saturation;
- a salinity in range 0-40 ppt; and
- a temperature of 0-45 degree Celsius

A membrane electrode with automatic temperature compensation complete with a cable was installed.

# Turbidity Measurement Instrument

A portable and weatherproof turbidity meter (HACH model 2100Q) was used during impact monitoring. It has a photoelectric sensor capable of measuring turbidity between 0-1000 NTU. Response of the sensor was checked with certified standard Turbidity solutions before the start of measurement.

#### For Water Sampling and Sample Analysis

In-situ monitoring was carried out at three depths: 1 meter below water surface, at mid-depth and 1 meter above the seabed. If the water depth is less than 6 m, the mid-depth station shall be omitted and if the water depth is below 3 m, only the mid depth station shall be monitored.

#### Water Sampler

A water sampler comprising a transparent PVC cylinder, with a capacity of not less than 2 liters, was lowered into the water body at the predetermined depth. The both opening ends of the sampler were then closed accordingly by dead weight and water samples were collected.

#### Water Container

The sample container, made by high-density polythene, was rinsed with a portion of the water sample. The water sample was then transferred to the container, labelled with a unique sample ID and sealed with a screw cap. The water samples were stored in a cool box maintained at 4°C. The water samples were then delivered to a local HOKLAS-accredited laboratory (Environmental Laboratory, ETS-Testconsult Ltd, HOKLAS Registration No. 022) on the same day for analysis.

The summary of testing method of testing parameter as recommended by EIA or required by EPD, with the QA/QC results in accordance with the requirement of HOKLAS or international accredited scheme is shown in Table 6.5.

Laboratory Analysis	Testing Procedure	Detection Limit
Total suspended solids	In house method based on APHA 19 <sup>th</sup> ed 2540D	1.0 mg/L

#### In-situ measurement

All in-situ monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme before use. Responses of sensors and electrodes were checked with certified standard solutions before each use. Wet bulb calibration for a DO meter was carried out before the start of measurement.

At each measurement/sampling depth, two consecutive measurements of dissolved oxygen (DO), dissolved oxygen saturation (DOS), turbidity and salinity were taken. For turbidity measurement, the sample was collected by using sampler and then transferred to the cell. The reading of turbidity of the sample was directly recorded from the Turbidimeter (HACH 2100Q) after inserting the cell to the Turbidimeter. For DO, DOS and Salinity, duplicate measurements were performed by dropping the calibrated probes of the corresponding monitoring equipments to the designated depths of the water column and taking readings after stabilized. The duplicate measurements were averaged if the difference was not greater than 25%. If the difference is greater than 25%, repeat measurement will be required.

Table 6.6 shows the equipment used for in-situ monitoring of water quality. The calibration certificates are attached in Appendix D1.

Parameter	Model	Date of Calibration	Due Date	Equipment No.
Coordinate of Monitoring stations	Garmin eTrex 10			ET/EW/005/09



ENA94329 Monthly EM&A Report No.25

Dissolved Oxygen (Saturation), Temperature, Salinity	YSI Dissolved Oxygen, Salinity & Temperature Meter, YSI 2030	02/03/19	01/06/19	ET/EW/008/006*
Turbidity	HACH Model 2100Q Turbid Meter	25/04/19	24/07/19	ET/0505/021*
Water Depth	Speedtech SM-5			ET/EW/002/08

Remark:(\*) indicates the instrument should be calibrated on use.

#### 6.6 Action and Limit Level

The water quality criteria, namely Action and Limit (A/L) levels are presented in the table below.

Table 6.7	Water Quality Action and Limit Levels	
Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface &amp; Middle</u> <5.45 mg/L (5%-ile of baseline data) <u>Bottom</u> <4.72 mg/L (5%-ile of baseline data)	<u>Surface &amp; Middle</u> <5.10 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth- averaged)	>6.74 mg/L (95%-ile of baseline data) or >120% of the upstream control station's SS at the same tide on the same day	>7.67 mg/L (99%-ile of baseline data) or >130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth- averaged)	>4.28 NTU (95%-ile of baseline data) or >120% of the upstream control station's turbidity at the same tide on the same day	>4.58 NTU (99%-ile of baseline data) or >130% of the upstream control station's turbidity at the same tide on the same day

# Table 6.7 Water Quality Action and Limit Levels

The water quality Action and Limit Levels (3RS project) are presented in the table below.

<b>T</b>		
Table 6.8	Water Quality Action and Limit Levels (3RS project)	

	Water Quality / totion and Einit Eevels (of	
Parameter	Action Level	Limit Level
DO (mg/L)	<u>Surface &amp; Middle</u> <5.5 mg/L <u>Bottom</u> <5.2 mg/L	<u>Surface &amp; Middle</u> <4.00 mg/L (1%-ile of baseline data) <u>Bottom</u> <2.00 mg/L
SS (mg/L) (Depth- averaged)	>4.9 mg/L or >120% of the upstream control station's SS at the same tide on the same day	>5.2 mg/L or >130% of the upstream control station's SS at the same tide on the same day
Turbidity (NTU) (Depth- averaged)	>3.9NTU or >120% of the upstream control station's turbidity at the same tide on the same day	>4.2 NTU or >130% of the upstream control station's turbidity at the same tide on the same day

## 6.7 Event and Action Plan

Please refer to the Appendix F for details.

## 6.8 Monitoring Duration in this reporting period

Below is the time schedule for the marine water quality monitoring events that were conducted in this reporting period:

Table 6.9	Time Schedule of Impact Marine Water Quality Moni	torina

May 2019							
Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday	
			1/5	2	3	4	
				▼		▼	
5	6	7	8	9	10	11	
	▼		▼		▼		

٦



ENA94329 Monthly EM&A Report No.25

12	13	14	15	16	17	18
		▼		▼		▼
19	20	21	22	23	24	25
	▼		▼		▼	
26	27	28	29	30	31	
	▼	-	▼		▼	

Remark: (  $\mathbf{\nabla}$  ) = Marine water quality monitoring carried out by ET.

The daily marine water quality monitoring duration are detailed in Appendix D2.

#### 6.9 Marine Water Quality Monitoring Results

The impact water quality measurement results are detailed in Appendix D2. Appendix D3 presents the water quality monitoring data and graphical presentations of monitoring results. The summary of marine water quality exceedances is shown in Table 6.10.

Station	Exceedance	DO		Turbidity		SS		Total	
Station	Level	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
TKO-C1	Action	0	0	0	0	0	0	0	0
160-01	Limit	0	0	0	0	0	0	0	0
TKO-M4	Action	0	0	0	0	0	0	0	0
170-1014	Limit	0	0	0	0	0	0	0	0

Table 6.10Summary of Impact Marine Water Quality Exceedances

The impact water quality measurement results (3RS project) are detailed in Appendix D4. Appendix D5 presents the water quality monitoring data and graphical presentations of monitoring results. The summary of marine water quality exceedances (3RS project) is shown in Table 6.11.

10010-0.11									
Station	Exceedance	DO		Turbidity		SS		Total	
Station	Level	Flood	Ebb	Flood	Ebb	Flood	Ebb	Flood	Ebb
C1a	Action	0	0	0	0	0	0	0	0
Cla	Limit	0	0	0	0	0	0	0	0
M4a	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0
М5	Action	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0

 Table 6.11
 Summary of Impact Marine Water Quality Exceedances (3RS project)

According to the summary of marine water monitoring results, no exceedance of Action and limit levels was recorded for this reporting period.

#### 7.0 ENVIRONMENTAL AUDIT

#### 7.1 Weekly ET Site Inspections and EPD's Site Inspection

#### 7.1.1 Weekly ET Site Inspections

Weekly ET site inspections were carried out by ET to monitor the timely implementation of proper environmental pollution control and mitigation measures for the Project. In this reporting period, four weekly site inspections were conducted (08, 15, 22 and 27 May 2019). Table 7.1 presents the key findings of weekly ET site inspection in this reporting period.



Table 7.1	Key Findings of Week	y ET Site Audits in this re	eporting period	
Date	Key Findings	Action(s) Taken recommended by ET	Action(s) Taken by the Contractor during the ET weekly site audit	Rectification Status by ET
08 May 2019	No defective work or	observation was recorded du	ring the weekly ET site inspec	tion
15 May 2019	No defective work or	observation was recorded du	ring the weekly ET site inspec	tion
22 May 2019	Oil stains were observed beside the generator near asphalt deposition platform.(New Item)	To clean the oil stain properly.		Follow-up
27 May 2019	Oil stains were observed beside the generator near asphalt deposition platform.(Previous Item)	To clean the oil stain properly.	Oil stains near asphalt deposition platform were cleaned	Closed
	Silting screen was found performance degradation near Area A5a. (New Item)	Replace the silting screen properly.		Follow-up

#### 7.1.2 EPD's Site Inspection

EPD's site inspection was carried out at TKO137 Fill Blank on 7, 15 & 27 May 2019.

#### 7.2 Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. The observations for the monitoring works were recorded and summarized as follows:

#### Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the site.
- The monitoring team recorded the temperature, air pressure and general weather condition on the monitoring day.

#### **Noise Monitoring**

- The monitoring team recorded the observations around the monitoring station, which might affect the results.
- Major noise sources were identified and recorded.

#### Water Quality Monitoring

The monitoring team recorded the observations around the monitoring stations, which might affect the results.

#### 7.3 Assessment of Environmental Monitoring Results

All monitoring results were audited against the Action and Limit levels and any exceedance would be validated.

No exceedance was recorded in water quality, air quality and noise monitoring in this reporting period.

The monitoring results in this reporting period were comparable with those of baseline month. Detailed discussions were given in Section 4, 5 and 6 of this Report.

#### 7.4 Advice on the Solid and Liquid Waste Management Status

The Contractor usually disposed of non-inert waste, including general refuse and materials segregated from the existing stockpiles, to SENT landfill. Table 7.2 summarizes data on offsite waste disposal in this reporting period.

Waste Type	Actual Amount	Disposal Locations					
Public Fill ('000m <sup>3</sup> )	0	TKO 137 Fill Bank					
C&D Waste ('000kg)	230.57	SENT Landfill / Refuse Collection Point					
Chemical Waste (kg/L)	0	Collected by licensed collector					

 Table 7.2
 Actual amounts of Waste generated in this reporting period



The Contractor should provide sufficient preventive measures during equipment maintenance works so as to avoid oil leakage on the ground. In the event of any oil leakage, the Contractor should clean up the polluted soil and handle all the materials used for this cleaning works as chemical waste.

Concrete bunding has erected outside the CEDD combined reception office and near the automatic wheel washing facilities for storing generator sets and oil drums. The drain outlet of all the bunded areas should be plugged properly. Besides, pre-cast drip trays were provided for oil drums at several areas, such as workshop and chemical storage area. The Contractor should collect and dispose of any stagnant water accumulated in the concrete bunding and drip trays and handle them as chemical waste.

The Contractor should use suitable containers with proper labels to store chemical wastes in accordance with Code of Practice on the Packaging, Labeling and Storage of Chemical Waste. The Contractor should also advise their workers of the proper procedures in handling the chemical waste. All the trip tickets for chemical waste disposal were properly kept in the site office.

The Contractor was reminded to increase the frequency of inspection and cleaning of the site drainage system, including permanent desilting chambers, desilting facilities, oil interceptor bypass tank, DP3 and DP4 and all the trapezoidal channels. Moreover, the Contractor should apply approved pesticides in the stagnant water ponds.

All the runoff from the parking area should be pumped to the desilting facilities and oil interceptors to remove suspended solids and oil & grease prior to discharge.

## 8.0 Status of Environmental Licensing and Permitting

All permits/licenses valid in this reporting period are summarized in Table 8.1.

Description	Permit No.	Valid	Period	Section
		From	То	
Environmental Permit	EP- 134/2002/ M	17/12/18		<ul> <li>Site clearance</li> <li>Construction of a temporary storm water system</li> <li>Stockpiling of 6 million m3 of public fill</li> <li>Setting up two barging points for transporting the stockpiled public fill by barges</li> <li>Setting up a temporary barging point at the existing Explosive Off-loading Barging Point for the month of May 2004 to December 2004 for transporting the stockpiled public fill by barge</li> <li>Construction of operation of a construction and Demolition Material Sorting Facility (C&amp;DMSF)</li> <li>Setting up a Construction and Demolition Material Crushing Facility at the TKO Basin</li> <li>Remove the temporary fill bank</li> </ul>
Marine Dumping Permit	EP/MD/19- 115	03/04/19	30/06/19	<ul> <li>Approval for dumping 3,000,000 tons (approximately equal to 1,666,667 cu.m. bulked quantity) of Public Fill (Reclamation Materials) from Tseung Kwan O Area 137 Fill Bank and Tuen Mun Area 38 Fill Bank to designated dumping area at Guanghaiwan of Taishan</li> </ul>
Chemical Waste Producer	5919-839- C4181-01	19/04/17		<ul> <li>Spent battery cell containing heavy metals and spent lubricating oil</li> </ul>
Effluent Discharge License	WT000291 78-2017	27/09/17	30/09/22	<ul> <li>Effluent, Surface Run-off, and all other wastewater discharges from screen and sedimentation tank</li> </ul>
Billing Account for Waste Disposal	7027643	22/05/17		
Notification Pursuant to Section 3(1)	415682	12/04/17		

 Table 8.1
 Summary of environmental licensing and permit status



of the Air			
Pollution			
Control			
(Construction			
Dust)			

#### 9.0 ENVIRONMENTAL NON-CONFORMANCE

#### 9.1 Summary of air quality, noise and marine water quality

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting period.

Since no documented complaints on noise issue were received in this reporting period, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting period.

#### 9.2 Summary of Environmental Complaints

One complaint was received in this reporting period.

#### 9.3 Summary of Notification of Summons and successful Prosecution

There was no notification of summons and successful prosecution respect to environmental issues registered in this reporting period.

#### **10.0 IMPLEMENTATION STATUS**

#### **10.1** Implementation Status of Environmental Mitigation Measures

An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix I. Most of the necessary mitigation measures were implemented properly. Any deficiencies were noted in the remarks of the schedule.

#### 10.2 Implementation Status of Event and Action Plan

Since no exceedance of Action and Limit level of air quality, noise and marine water monitoring results was recorded for this reporting period, no further action was required.

# 10.3 Implementation Status of Environmental Complaint, Notifications of Summons and Successful Prosecutions Handling

One complaint received on 14 May 2019, which was forwarded to ET on 14 May 2019, from public against 投訴將軍澳第 137 區填料庫,有車出入沒有灑水傳出大量沙塵,破壞環境,帶出大量沙泥到馬路,造成污染及嚴重滋擾,要求跟進。要求改善,停止滋擾。

No notification of summon and successful prosecution was received in this reporting period.

A summary of environmental complaints, notifications of summons and successful prosecutions was given in Table 10.1 and further details of the complaint could be found in the Complaint Log (Appendix L).

		ntai oompiamto a	na i ioooouu	5110				
Complaints lo	ogged	Summons	served	Successful prosecution received				
May 2019	Cumulative	May 2019	Cumulative	May 2019	Cumulative			
1	5	0	0	0	0			

 Table 10.1
 Summary of Environmental Complaints and Prosecutions

東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

### 11.0 CONCLUSIONS AND RECOMMENDATIONS

#### **Conclusions**

Impact monitoring of air quality, noise and water quality were carried out at designated locations in accordance with the EM&A Manual in this reporting period.

No Action and Limit level exceedance of 1-hour and 24-hr TSP monitoring was recorded in this reporting period.

Since no documented complaints on noise issue were received in this reporting period, no Action Level exceedance was recorded. Besides, no exceedance in Limit Level was recorded according to the result from Day-time monitoring.

According to the summary of marine water monitoring results, no exceedance of Action and Limit levels was recorded for this reporting period.

One complaint received on 14 May 2019, no prosecutions and notifications of summons were received in this reporting period.

According to the ET weekly site inspections carried out in this reporting period, the Contractor generally implemented sufficient dust mitigation measures, including operation of the mist spraying systems and automatic wheel washing facilities, dampening of haul roads and stockpiling areas.

#### **Recommendations**

According to the environmental site inspections performed in the reporting period, the following recommendations were provided:

#### Air Quality

- Ensure the frequency of water spraying on haul roads, unloading areas and stockpiles to be sufficient to suppress the dust sources;
- Provide proper maintenance for the powered mechanical equipment and barges to avoid emission of dark smoke;
- Provide water spraying onto the truckloads during inspection of fill material;
- Conduct road sweeping on all paved haul roads and public roads especially outside and near the site egress by the road sweeper. Undertake water spraying on stockpiling area by water bowser;
- Erect adequate speed limit signs to advise the truck drivers of the speed limit;
- Operate mist spraying systems and automatic water sprinklers in the Fill Bank;
- Implement the dust mitigation measures for the site activities;
- Designate proper haul roads to ensure effective water spraying; and
- Ensure all vehicles to be washed before leaving the site egress by provision, operation and maintenance of automatic wheel washing facilities.

#### Noise

Conduct noisy activities at a farther location from the NSRs.

#### Water Quality

- Maintain the drainage system, including the trapezoidal channels, permanent desilting chambers, regularly;
- Operate and maintain the silt curtains regularly;
- Operate the cleaning vessel within the TKO Basin regularly;
- Clean up the fill material on the concrete pavement at BHA frequently; and
- Remove the stagnant water or provide approved pesticides for the stagnant water in the permanent desilting chambers, if any.

#### Landscape and Visual

- Provide hydroseeding on the exposed slopes, on which the final profile has been formed;
- Erect all the site hoarding/chaining fences in accordance with agreed design at proper location;
- Maintain the hydroseeded slopes in accordance with the Landscape Plan.

#### Chemical and Waste Management

- Remove waste materials from the site to avoid accumulation regularly;
- Handle and store chemical wastes properly;
- Remove unwanted material in the existing stockpiles and avoid further dumping of such material;



Contract No.: CV/2015/07 Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O Area 137 Fill Bank ENA94329 Monthly EM&A Report No.25

- Provide and maintain sufficient drip trays for diesel drums, chemical containers, chemical waste storage drums and diesel operated generator set;
- Maintain mesh screen on top of the additional drainage to avoid improper dumping of rubbish;
- Maintain good housekeeping at the workshop area;
- Ensure sufficient tarpaulin sheets are provided to cover drip trays; and
- Avoid soil being polluted during oil filling and equipment maintenance; hence, properly remove and store the contaminated soil, if any

#### 12.0 FUTURE KEY ISSUES

#### 12.1 Work Programme for the Coming Month

As informed by the Contractor, the activities to be conducted by them in the next month included: 1. Operation of the TKO137 Fill Bank.

- 2.Delivery of public fill to Taishan:
- 3. Operation of dewatering plant and expanded dewatering plant
- 4. Operation of bentonite pool.
- 5.Concrete block breaking work.

6.Crushing plant operation.

7.Removal of public fill at Portion A6

8. Construction of concrete pavement for Expanded Dewatering Plant

9. Provision of photoelectric height limits warning system at the existing height restriction gantries;

10.Re-construction of sampling platforms

11.Replacement of Y40 rebar with Y50 rebar at the existing wheel washing bay

12. Construction of concrete pavement at expanded dewatering plant

13. Repair works for damaged at TKOFB caused by Super Typhoon

14. Upgrading Works for Optical Fibre Cable System for CCTV at Tipping Halls of TKOFB;

15.Installation of Temporary Accommodation to CEDD Site Staff at TKOFB;

16.Demolition of Damaged Principle Site Office at TKOFB

17.Re-construction of CREO Room A at TKOFB

18.Demolition and Construction of Recorder House A2 at TKOFB;

19. Upgrade the Bituminous Access Road near Portion A10 of TKOFB;

### 12.2 Key Issues for the Coming Month

#### Key issues to be considered in the coming month include:

- Chemical and waste management;
- Treatment of runoff and wastewater prior to discharge;
- Dust generated from loading and unloading activities; and
- Dust generated from dump trucks traffic.

## Mitigation measures to be required in the coming month:

#### Air Quality Impact

- To provide adequate water spraying on haul roads and working platform;
- To operate and maintain automatic wheel washing facilities properly;
- To dampen the fill material prior to unloading or movement;
- To provide road sweeping on haul road near site egress and public roads outside site egress;
- To ensure implementation of the dust mitigation measures for the site activities;
- To maintain proper operation of the mist spraying system;
- To provide proper maintenance for vehicles and machines on site; and
- To investigate any other dust sources around the air sensitive receivers

### <u>Noise</u>

- To switch off equipment if not in use;
- To operate silent equipment;
- To identify the noise sources inside and outside of the site;
- To follow up any exceedance caused by the Fill Bank operation; and
- To re-schedule the work activities in the event of valid noise exceedance.

#### Water Quality Impact

- To maintain the drainage system in the Fill Bank;
- To ensure the cleanliness of oil interceptor bypass tanks and all the drainage channels;
- To maintain the existing silt trap to ensure good efficiency of wheel wash facilities;



ENA94329 Monthly EM&A Report No.25

- To repair, inspect and maintain the silt curtains regularly;
- To provide covers for the drip trays to avoid stagnant water pond due to rainfall;
- To deploy a cleaning vessel to remove floating rubbish in the TKO Basin;
- To clean up the concrete paved area at Portion I every night to avoid fill materials from being washed into the sea; and
- To avoid any stagnant water or provide insecticide to avoid mosquito breeding in the Fill Bank.

Chemical and Waste Management

- To remove waste from the site regularly;
- To properly store and handle chemical wastes on site;
- To implement trip ticket system for all the imported public fill and general refuse disposal;
- To provide and manage sufficiently sized drip trays for diesel drums or chemical containers;
- To remove existing unwanted material in the stockpiles and avoid improper disposal at the Fill Bank through inspection of imported truckloads;
- To maintain proper housekeeping at the workshop area;
- To remove the oil stains in the event of leakage and handle all materials using for this cleaning works as chemical waste;
- To maintain mesh screen on top of the additional drainage, DP3 opening to avoid improper dumping of rubbish into this channel; and
- To identify C&D material by packaging, labeling, storage, transportation and disposal in accordance with statutory regulations.

### 12.3 Monitoring Schedule for the Coming Month


The proposed EM&A program of the coming month is attached in Appendix K.

- END OF REPORT -



Appendix A

**Project Organization Chart** 

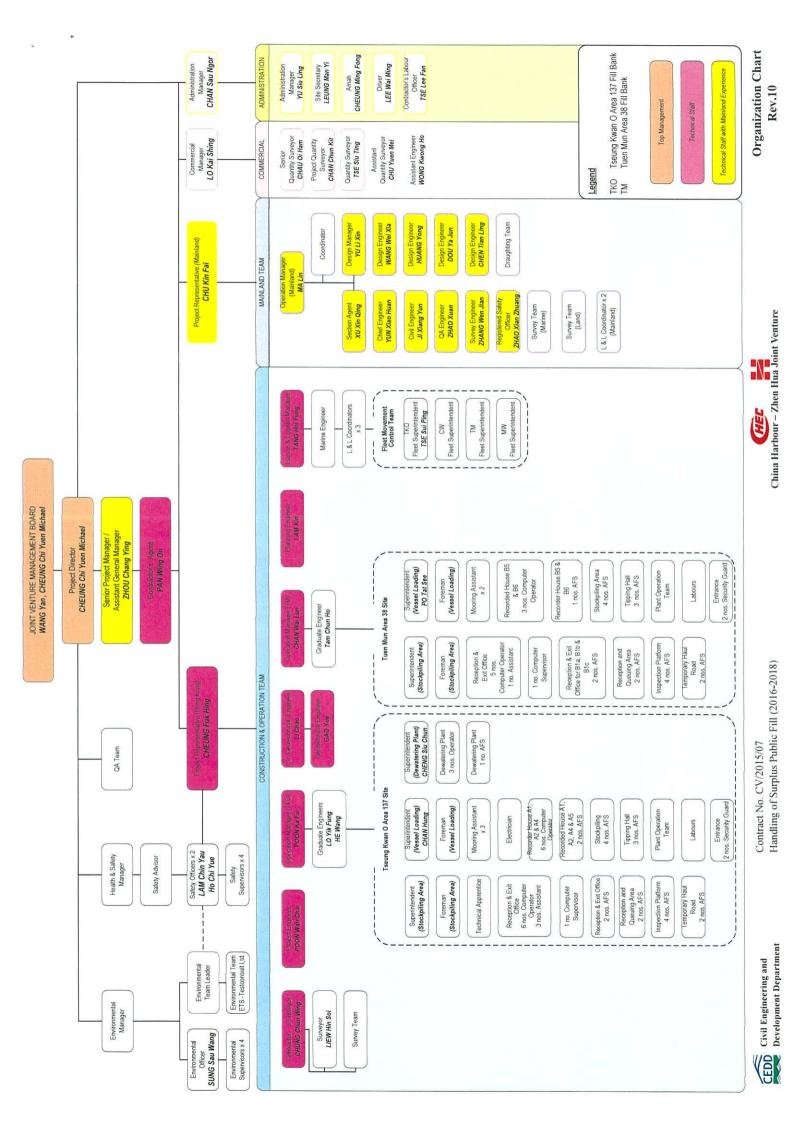



Appendix B1

Calibration Certificates for Impact Air Quality Monitoring Equipment



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong


T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

# **Calibration Report**

of High Volume Air Sampler

Manufacturer	:	Graseby 105 Da	Date of Calibration :				12 April 2019			
Serial No.	:	<u>9795 (ET/EA/003/18)</u> Ca	Calibration Due Date :				11 June 2019			
Method	:	Five-point calibration by using standard ca Operations Manual	alibration kit	Tisch TE-5	025	5A refe	er to the			
Results	:	Flow recorder reading (cfm)	48	43		36	31	27		
		Qstd (Actual flow rate, m <sup>3</sup> /min)	1.69	1.52	1	1.29	1.05	0.86		
		Pressure : 762.06 mm Hg		Temp. :		296	K			

# Sampler 9795 Calibration Curve Site: Tseung Kwan O 137 (TKO-A1)

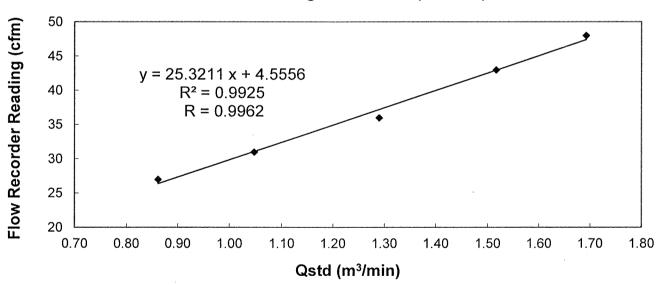

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by :

LIAO, Yun Chao (Technician)

Checked by

LAU, Chi Leung (Environmental Team Leader)

- END OF REPORT -



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong


T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

# **Calibration Report**

of High Volume Air Sampler

Manufacturer	:	Andersen G1051 D	ate of Calib	ration	:	12 April 2019							
Serial No.	:	<u>1176 (ET/EA/003/05)</u> C	ne 2019										
Method	:	Based on Operations Manual for the 5-po manufactured by Tisch TE-5025 A	Based on Operations Manual for the 5-point calibration using standard calibration kit manufactured by Tisch TE-5025 A										
Results	: Flow recorder reading (cfm) Qstd (Actual flow rate, m <sup>3</sup> /min)		55	47 1.52		42 1.37	33 1.01	25 0.83					
		Pressure : 762.06 mm Hg	<b>I</b>	Temp. :		296	ĸ						

Sampler 1176 Calibration Curve Site: Tseung Kwan O 137 (TKO-A2a)

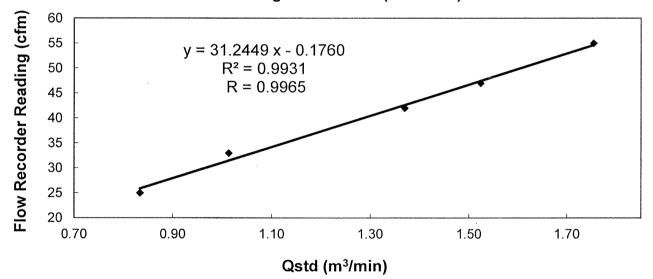

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable \* for use.

Calibrated by :

LIAO, Yun Chao (Technician)

Checked by :

LAU, Chi Leung

LAU, Chi Leung (Environmental Team Leader)

- END OF REPORT -

RECALIBRATION **DUE DATE:** March 15, 2020 Environmenta ertificate of alibration **Calibration Certification Information** °K Rootsmeter S/N: 438320 Ta: 293 Cal. Date: March 15, 2019 Pa: 760.7 mm Hg **Operator:** Jim Tisch Calibrator S/N: 3612 Calibration Model #: TE-5025A Vol. Final ΔVol. ΔΡ ΔН Vol. Init ∆Time (in H2O) (m3) (m3) (m3) (min) (mm Hg) Run 1.4500 3.2 2.00 1 1 2 1 4.00 2 3 4 1.0300 6.3 1 5.00 0.9220 7.8 3 5 6 1 4 7 0.8780 8.7 5.50 8 1 0.7220 12.6 8.00 5 9 10 1 **Data Tabulation**  $\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)$ √∆H( Ta/Pa) Vstd Ostd Qa (x-axis) (y-axis) (x-axis) (y-axis) Va (m3) 0.9958 0.6868 0.8777 1.0138 0.6991 1.4269 2.0180 0.9917 0.9628 1.2412 1.0096 0.9802 1.0735 1.3877 0.9897 1.0076 1.0928 2.2561 1.4555 1.0064 1.1462 2.3663 0.9886 1.1259 1.7553 0.9834 1.3621 1.0012 1.3867 2.8538 1.30142 2.07834 m= m= -0.01288 OSTD b= -0.02094QA b= 0.99994 0.99994 r= r= Calculations  $Va = \Delta Vol((Pa - \Delta P)/Pa)$ Vstd=  $\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$ Qstd= Vstd/∆Time **Qa=**  $Va/\Delta$ Time For subsequent flow rate calculations: Pa Tstd ,/∆H( Ta/Pa Qstd = 1/m/ΔН Qa= 1/m -h Pstd Ta **Standard Conditions** 298.15 °K RECALIBRATION Tstd: 760 mm Hg Pstd: US EPA recommends annual recalibration per 1998 Key 40 Code of Federal Regulations Part 50 to 51, ΔH: calibrator manometer reading (in H2O) ΔP: rootsmeter manometer reading (mm Hg) Appendix B to Part 50, Reference Method for the Ta: actual absolute temperature (°K) **Determination of Suspended Particulate Matter in** Pa: actual barometric pressure (mm Hg) the Atmosphere, 9.2.17, page 30 b: intercept m: slope

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002 <u>www.tisch-env.com</u> TOLL FREE: (877)263-7610 FAX: (513)467-9009



Appendix B2

Impact Air Quality Monitoring Results

# Summary of 24-hr TSP Monitoring Results



Monitoring Station : TKO-A1

Location : Site Egress

St	Start Fir		Finish Elapse		e Time	Sampling	Flow Rate (m <sup>3</sup> /min.)		Average	Filter W	Conc.	
Date	Time	Date	Time	Initial	Final	Time (hrs)	Initial	ial Final	(m <sup>3</sup> /min.)	Initial	Final	(µg/m <sup>3</sup> )
04/05/2019	08:00	05/05/2019	08:00	20210.74	20234.74	24.00	1.1233	1.1233	1.1233	2.5982	2.7590	99
10/05/2019	09:00	11/05/2019	09:00	20237.74	20261.74	24.00	1.1233	1.1233	1.1233	2.6672	2.8372	105
16/05/2019	08:30	17/05/2019	08:30	20264.74	20288.74	24.00	1.1233	1.1233	1.1233	2.7835	2.9022	73
22/05/2019	16:10	23/05/2019	16:10	20291.74	20315.74	24.00	1.1233	1.1233	1.1233	2.7610	2.9310	105
28/05/2019	08:00	29/05/2019	08:00	20318.74	20342.74	24.00	1.0839	1.0839	1.0839	2.6966	2.8202	79

Monitoring Station : TKO-A2a

Location : CREO

St	Start Fi		Finish Elapse Ti		e Time	Sampling	Flow Rate (m <sup>3</sup> /min.)		Average	Filter W	Conc.	
Date	Time	Date	Time	Initial	Final	Time (hrs)	Initial	Final	(m <sup>3</sup> /min.)	Initial	Final	(µg/m <sup>3</sup> )
04/05/2019	08:00	05/05/2019	08:00	22304.61	22328.61	24.00	1.0618	1.0618	1.0618	2.5792	2.7084	85
10/05/2019	09:15	11/05/2019	09:15	22331.61	22355.61	24.00	1.0618	1.0618	1.0618	2.5765	2.6953	78
16/05/2019	08:30	17/05/2019	08:30	22358.61	22382.61	24.00	1.0938	1.0938	1.0938	2.5678	2.7023	85
22/05/2019	14:50	23/05/2019	14:50	22385.61	22409.61	24.00	1.0618	1.0618	1.0618	2.7889	2.9463	103
28/05/2019	08:00	29/05/2019	08:00	22412.61	22436.61	24.00	1.0298	1.0298	1.0298	2.7443	2.8445	68

# Summary of 1-hr TSP Monitoring Results



Monitoring Station : TKO-A1

Location : Site Egres Site Egress

Start		Finish		Elapse Time		Sampling	Flow Rate (m <sup>3</sup> /min.)		Average	Filter W	Conc.	
Date	Time	Date	Time	Initial	Final	Time (hrs)	Initial	Final	(m <sup>3</sup> /min.)	Initial	Final	(µg/m³)
03/05/2019	09:15	03/05/2019	10:15	20209.74	20210.74	1.00	1.1233	1.1233	1.1233	2.6772	2.6865	138
06/05/2019	09:00	06/05/2019	10:00	20234.74	20235.74	1.00	1.0839	1.0839	1.0839	2.7386	2.7426	62
06/05/2019	10:10	06/05/2019	11:10	20235.74	20236.74	1.00	1.0839	1.0839	1.0839	2.6998	2.7066	105
08/05/2019	13:00	08/05/2019	14:00	20236.74	20237.74	1.00	1.0839	1.0839	1.0839	2.6495	2.6638	220
15/05/2019	09:00	15/05/2019	10:00	20261.74	20262.74	1.00	1.1233	1.1233	1.1233	2.6854	2.6956	151
15/05/2019	10:47	15/05/2019	11:47	20262.74	20263.74	1.00	1.1233	1.1233	1.1233	2.6744	2.6811	99
15/05/2019	14:58	15/05/2019	15:58	20263.74	20264.74	1.00	1.1233	1.1233	1.1233	2.7244	2.7327	123
17/05/2019	13:00	17/05/2019	14:00	20288.74	20289.74	1.00	1.0839	1.0839	1.0839	2.7870	2.8045	269
17/05/2019	15:36	17/05/2019	16:36	20289.74	20290.74	1.00	1.0839	1.0839	1.0839	2.7845	2.7991	224
20/05/2019	10:06	20/05/2019	11:06	20290.74	20291.74	1.00	1.0839	1.0839	1.0839	2.7907	2.8056	229
24/05/2019	10:49	24/05/2019	11:49	20315.74	20316.74	1.00	1.1233	1.1233	1.1233	2.7879	2.7951	107
24/05/2019	13:00	24/05/2019	14:00	20316.74	20317.74	1.00	1.1233	1.1233	1.1233	2.7804	2.7915	165
27/05/2019	09:50	27/05/2019	10:50	20317.74	20318.74	1.00	1.0839	1.0839	1.0839	2.7666	2.7782	178
29/05/2019	09:00	29/05/2019	10:00	20342.74	20343.74	1.00	1.0839	1.0839	1.0839	2.7818	2.7937	183
29/05/2019	10:40	29/05/2019	11:40	20343.74	20344.74	1.00	1.0839	1.0839	1.0839	2.7658	2.7801	220
31/05/2019	13:00	31/05/2019	14:00	20344.74	20345.74	1.00	1.1233	1.1233	1.1233	2.8313	2.8513	297

Monitoring Station : TKO-A2a

Location : CREO



#### 東業德勤測試顧問有限公司 ETS-TESTCONSULT LIMITED


Filter Weight (g) Start Finish Elapse Time Flow Rate (m<sup>3</sup>/min.) Sampling Average Conc. (µg/m<sup>3</sup>)  $(m^3/min.)$ Time (hrs) Time Initial Date Date Time Initial Final Final Initial Final 03/05/2019 09:20 03/05/2019 10:20 22303.61 22304.61 1.00 1.0298 1.0298 1.0298 2.6899 2.6949 81 06/05/2019 09:05 06/05/2019 22328.61 22329.61 1.0298 1.0298 10:05 1.00 1.0298 2.7187 2.7221 55 06/05/2019 10:30 06/05/2019 11:30 22329.61 22330.61 1.00 1.0298 1.0298 1.0298 2.7008 2.7070 100 08/05/2019 13:03 08/05/2019 14:03 22330.61 22331.61 1.00 1.0298 1.0298 1.0298 2.6583 2.6683 162 15/05/2019 09:30 15/05/2019 10:30 22355.61 22356.61 1.00 1.0938 1.0938 1.0938 2.6672 2.6740 104 15/05/2019 15/05/2019 10:56 11:56 22356.61 22357.61 1.00 1.0938 1.0938 1.0938 2.6553 2.6650 148 15/05/2019 15/05/2019 14:40 15:40 22357.61 22358.61 1.00 1.0938 1.0938 1.0938 2.6682 2.6771 136 17/05/2019 13:00 17/05/2019 22382.61 22383.61 1.0298 1.0298 1.0298 2.7917 212 14:00 1.00 2.7786 17/05/2019 15:45 17/05/2019 16:45 22383.61 22384.61 1.00 1.0298 1.0298 1.0298 2.7916 2.8077 261 20/05/2019 10:13 20/05/2019 11:13 22384.61 22385.61 1.00 1.0298 1.0298 1.0298 2.7912 2.8087 283 24/05/2019 10:51 24/05/2019 11:51 22409.61 22410.61 1.00 1.0298 1.0298 1.0298 2.7367 2.7430 102 24/05/2019 24/05/2019 13:00 14:00 22410.61 22411.61 1.00 1.0298 1.0298 1.0298 2.7652 2.7754 165 27/05/2019 10:00 27/05/2019 11:00 22411.61 22412.61 1.00 1.0298 1.0298 1.0298 2.8062 2.8140 126 29/05/2019 09:07 29/05/2019 10:07 22436.61 22437.61 1.00 1.0298 1.0298 1.0298 2.7627 2.7719 149 29/05/2019 10:46 29/05/2019 11:46 22437.61 22438.61 1.00 1.0298 1.0298 1.0298 2.7715 2.7842 206 31/05/2019 13:00 31/05/2019 14:00 22438.61 22439.61 1.00 1.0298 1.0298 1.0298 2.7958 2.8106 240




Appendix B3

# **Graphical Plots of Impact Air Quality Monitoring Data**



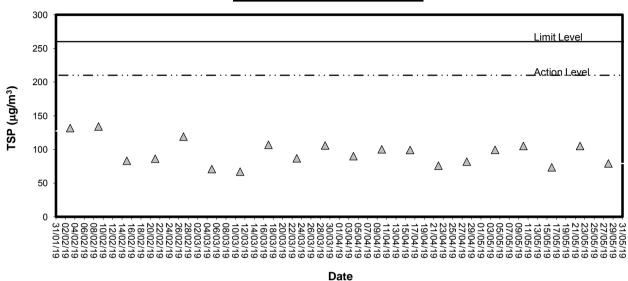


# 24-hour TSP level at TKO-A1

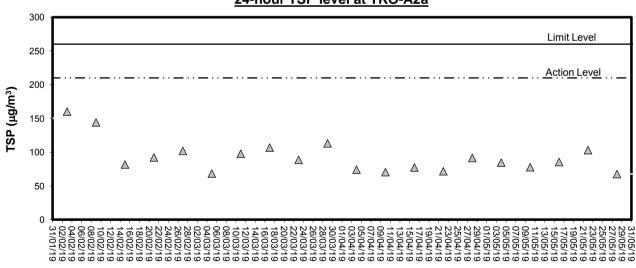


24-hour TSP level at TKO-A2a

Date



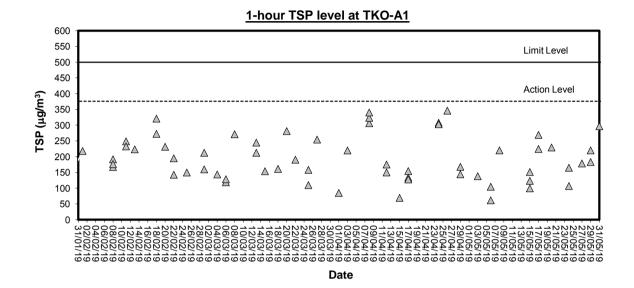

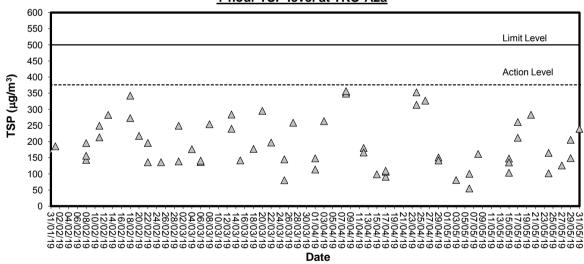

1-hour TSP level at TKO-A2a



Appendix C1

Calibration Certificates for Impact Noise Monitoring Equipment



# **Calibration Certificate**

Certificate No.	810241		Page	1 of 2	Pages
Customer :	ETS-Testconsult Limited				
Address :	8/F., Block B, Veristrong Indu	ustrial Centre, 34-36 Au	u Pui Wan St., Fo	otan, Hong K	ong.
Order No. :	Q84111		Date of receip	t :	15-Oct-18
Item Tested			<u></u>		
Description :	Sound Level Calibrator				
Manufacturer :	Rion		I.D.	: ET/EN	/002/01
Model :	NC-73	·····	Serial No.	: 10196	943
Test Conditi	ons				
Date of Test :	23-Oct-18		Supply Voltag	e :	
Ambient Temp	erature : (23 ± 3)°C		Relative Humi	dity: (50 ± 2	25) %
Test Specifi	cations				
Calibration chec	ck.				
Ref. Document/	Procedure : F21, Z02.				
Test Results	<u></u>				
restresuite	•				
	within the manufacturer's spe				
The results are	shown in the attached page(s	\$).			
Main Test equip	oment used:				
Equipment No.	Description	<u>Cert. No.</u>		Traceable I	<u>.o</u>
S014	Spectrum Analyzer	805025			& SCL-HKSAR
S240	Sound Level Calibrator	803357			& SCL-HKSAR
S041	Universal Counter	802061		SCL-HKSA	
S206	Sound Level Meter	805027		SCL-HKSA	R
will not include allow overloading, mis-ha	this Calibration Certificate only relat wance for the equipment long term d andling, or the capability of any other age resulting from the use of the equ	rift, variations with environme laboratory to repeat the mea	ental changes, vibrat	tion and shock d	luring transportation,
	used for calibration are traceable to bly to the above Unit-Under-Test only		s (SI), or by reference	ce to a natural co	onstant.
NO					Generative
<b>A H H H</b>	X H	A	wavad bu	(hA)	
Calibrated by	Elva Chong	Ар	proved by :	Kin Wong	
This Certificate is issued I	by:	Date	e: 23-Oct-18		
Hong Kong Calibration Lt	a				

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong. Tel: 2425 8801 Fax: 2425 8646



# **Calibration Certificate**

Certificate No. 810241

Page 2 of 2 Pages

Results :

### 1. Level Accuracy (at 1 kHz)

UUT Nomin	nal Value	Measured Value	Mfr's Spec.
94	1B	94.2 dB	$\pm 1 \text{ dB}$

Uncertainty :  $\pm 0.2 \text{ dB}$ 

#### 2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	1.017 kHz	± 2 %

Uncertainty :  $\pm 0.1$  %

- **3.** Level Stability : 0.0 dB Uncertainty : ± 0.01 dB
- Total Harmonic Distortion : < 0.3 % Mfr's Spec. : < 3 % Uncertainty : ± 2.3 % of reading

### Remarks: 1. UUT : Unit-Under-Test

- 2. The uncertainty claimed is for a confidence probability of not less than 95%.
- 3. Atmospheric Pressure : 1 018 hPa

----- END -----

The copyright of this certificate is owned by Hong Kong Calibration Ltd., It may not be reproduced except in full.



Hong Kong Calibration Ltd. 香港校正有限公司

# **Calibration Certificate**

Certificate No.	901292		Page	1 of	3 Pages
Customer :	ETS-Testconsult Limited				
Address :	8/F., Block B, Veristrong Industria	al Centre, 34-36 Au	Pui Wan St., Fot	tan, Hong	Kong.
Order No. :	Q90546		Date of receipt	:	14-Feb-19
Item Tested				•	
Description :	Sound Level Meter				
Manufacturer :	Rion		I.D.	: ET/E	E <b>N</b> /003/18
Model :	NL-52		Serial No.	: 0026	64520
Test Conditi	ons				
Date of Test :	27-Feb-19		Supply Voltage	:	
Ambient Temp	erature: (23 ± 3)°C		Relative Humid	lity:(50:	± 25) %
Test Specific	cations				
Calibration chec Ref. Document/	k. Procedure: Z01, IEC 61672.				
Test Results	;				
All results were	within the IEC 61672 Type 1 or m	anufacturer's speci	fication.		
	shown in the attached page(s).				
Main Test equip	ment used:				
Equipment No.	Description	<u>Cert. No.</u>		Traceabl	<u>e to</u>
S017	Multi-Function Generator	C190926		SCL-HK	SAR
S240	Sound Level Calibrator	803357		NIM-PR	C & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

Calibrated by :

Elva Chong

Approved by : Kin Wong

Date: 27-Feb-19

This Certificate is issued by: Hong Kong Calibration Ltd. Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street,Kwai Chung, NT,Hong Kong. Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



# **Calibration Certificate**

Certificate No. 901292

Page 2 of 3 Pages

Results :

### Acoustical signal test

1. Self-generated noise: 15.9 dBA (Mfr's Spec  $\leq$  17 dBA)

### 2. Reference Sound Pressure Level

	UUT S					
	Frequency	Time	Octave	Applied	UUT	
Range (dB)	Weighting	Weighting	Filter	Value (dB)	Reading (dB)	
20~130	A	F	OFF	94.0	94.0	
		S			94.0	
	С	F	OFF		94.0	
	Z	F	OFF		94.0	
	A	F	OFF	114.0	114.0	
		S	OFF		114.0	
	С	F	OFF		114.0	
	Z	F	OFF	]	114.0	

IEC 61672 Type 1 Spec. :  $\pm$  1.1 dB Uncertainty :  $\pm$  0.1 Db

#### **Electrical signal tests**

# 3. Electrical signal tests of frequency weightings (A weighting)

Frequency	Attenuation (dB)	IEC 61672 Type 1 Spec.
31.5 Hz	-39.6	- 39.4 dB, ± 2 dB
63 Hz	-26.3	- 26.2 dB, ± 1.5 dB
125 Hz	-16.2	- 16.1 dB, $\pm$ 1.5 dB
250 Hz	-8.7	- $8.6 \text{ dB}, \pm 1 \text{ dB}$
500 Hz	-3.3	- $3.2 \text{ dB}, \pm 1.4 \text{ dB}$
1 kHz	0.0 (Ref)	$0 \text{ dB}, \pm 1.1 \text{ dB}$
2 kHz	+1.2	$+$ 1.2 dB, $\pm$ 1.6 dB
4 kHz	+1.0	$+ 1.0 \text{ dB}, \pm 1.6 \text{ dB}$
8 kHz	-1.1	- 1.1 dB, +2.1 dB ~ -3.1 dB
16 kHz	-8.0	- $6.6 \text{ dB}, + 3.5 \text{ dB} \sim -17.0 \text{ dB}$

Uncertainty :  $\pm 0.1 \text{ dB}$ 

The copyright of this certificate is owned by Hong Kong Calibration Ltd., It may not be reproduced except in full.



Hong Kong Calibration Ltd.

# 香港校正有限公司

# **Calibration Certificate**

Certificate No. 901292

Page 3 of 3 Pages

#### 4. Frequency & Time weightings at 1 kHz

4.1 Frequency Weighting (Fast)

UUT	Applied	UUT	Difference	IEC 61672
Setting	Value (dB)	Reading (dB)	(dB)	Type 1 Spec.
A	94.0	94.0 (Ref.)		± 0.4 dB
С	94.0	94.0	0.0	
Z	94.0	94.0	0.0	

#### 4.2 Time Weighting (A-weighted)

112 11110 11 0.0	(		1	
UUT	Applied	UUT	Difference	IEC 61672
Setting	Value (dB)	Reading (dB)	(dB)	Type 1 Spec.
Fast	94.0	94.0 (Ref.)		± 0.3 dB
Slow	94.0	94.0	0.0	
Time-averaging	94.0	94.0	0.0	

Uncertainty :  $\pm 0.1 \text{ dB}$ 

Remarks : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure : 1 001 hPa.

- 4. Preamplifier model : NH-25, S/N : 64645
- 5. Firmware Version: 1.7

6. Power Supply Check: OK

7. The UUT was adjusted with the laboratory's sound calibrator at the reference sound pressure level before the calibration.

----- END -----

The copyright of this certificate is owned by Hong Kong Calibration Ltd., It may not be reproduced except in full.



Appendix C2

Impact Noise Monitoring Results



# Day-time Noise Monitoring

# Monitoring Location: TKO-N1 (Site Egress)

Date	Start Sampling Time	No	ise Level dB	(A)	Wind	Weather		
	(hh:mm)	L <sub>eq(30min)</sub>	L <sub>10</sub>	L <sub>90</sub>	Speed (m/s)	Condition		
06/05/19	09:00	64.8	67.7	60.5	0.2	Drizzle		




Appendix C3

**Graphical Plots of Impact Noise Monitoring Data** 



# Noise Monitoring (Day-time)

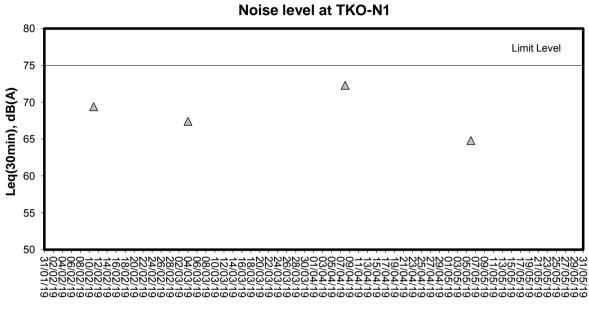

Date



Appendix D1

Calibration Certificates for Impact Marine Water Quality Monitoring Equipments



Form E/CE/R/24 Issue 1 (1/1) [01/18]

Calibration Report of Dissolved Oxygen Meter (In situ Measurement)										
Equipment Ref. No.	ET/EW/008/006		Manufacturer	:YSI						
Model No.	Pro 2030		Serial No.	: 12A100554						
Calibration Date	2/3/2019		Calibration Due Date	: 1/6/2019						
Temperature Verific	ation by Reference Thermometer	(ET/0521/028)		8						
	Temperature Reading (°C)	Correction (°C)	Corrected Temperature	e (°C) Difference (°C)						
Reference Thermome	eter 20.2	0.0	20.2	0.1						
DO Meter	20.3	0.0	20.3	0.1						
Criteria: Difference	between corrected temperature from	m DO meter and re	eference thermometer : •	< ± 0.5 °C						
Zero Point Checking	{		4							
I	OO meter reading (mg/L)		0.0	01						
Criteria: Zero check	ing: 0.0 mg/L									
Linearity Checking	of Dissolved Oxygen Content by A	PHA 19ed 4500-0	G							
	Expected DO value (mg/L)			Difference of DO Content						
Purging time, min	(ET/0510/012)	DO met	er reading (mg/L)	· (mg/L)						
2	6.22		6.41	0.19						
5	3.88	1	3.96	0.08						
10	2.15		2.31	0.16						
Criteria: Difference	between DO meter reading and exp	pected DO value: <	< ±0.30 mg/L							
Salinity Checking by	APHA 19ed 2520 B	<i>u</i> -								
		Expect	ed Salinity (ppt)	DO meter reading (ppt)						
Reagent No. of NaCl	(10 ppt): CPE/012/4.7/27		10	9.3						
Reagent No. of NaCl	(30 ppt): CPE/012/4.8/27		30	28.5						
Criteria: Difference	between DO meter reading and exp	pected Salinity: $\pm 1$	0.0 %							
/ <del>unacceptable</del> <sup>#</sup> for u		specified requirement	ents and is deemed accep	ptable <sup>#</sup>						
<sup>#</sup> Delete as appropria	te									
Calibrated by : Approved by :										



	Performance Check of Turbidity Meter										
Eq	uipment Ref. No. :ET/05	05/021	Manufacturer	: HACH							
	Model No. : 21	)0Q	Serial No.	:							
D	ate of Calibration : 25/4	/2019	Due Date	: 24/7/19							
	Theoretical Value of Turbidity Standard (NTU)	Measu	red Value (NTU)	Difference % *							
	20		20.2	1.0%							
	100		102	2.0%							
	800		785	-1.9%							
	(*) Difference = (Measured Va	lue – Theor	etical Value) / Theo	pretical Value x 100							
Ac	ceptance Criteria	fference : -	5 % to 5 %								
	The turbidity meter complies * / does not comply * with the specified requirements and is deemed acceptable * / unacceptable * for use. Measurements are traceable to national standards.										
Pre	pared by :		Checked by :	2							

đ

. ~

4



Appendix D2

# Impact Marine Water Quality Monitoring Results

# Mid-Flood Tide

#### Monitoring Station : TKO-C1

Date	Sampling	Ambient Temp	Monitorir	ng Depth	Temp	Salini				d Oxygen tion (%)	Тι	urbidity (NT	U)	Susper	nded Solids	s (mg/L)														
Dale	Duration	Duration	Duration	(°C) / Weather Condition	(°C) / Weather Condition	· · /	· · /	(n	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average							
			Surface	1.0	25.1	29.5	29.5	7.27	7.26		103.9	103.8	3.24	3.26		5.6	5.6													
						29.5		7.24		7.29	103.6		3.27			5.6		-												
02/05/19	1556-1615	22/Fine	Middle	11.3	24.9	29.7 29.6	29.7	7.30	7.32		103.9 104.1	104.0	3.55 3.58	3.57	3.31	4.9 5.1	5.0	5.1												
						29.0		7.07			104.1		3.12			5.0														
						Bottom	21.6	24.7	29.9	29.9	7.10	7.09	7.09	100.8	100.7	3.10	3.11		4.4	4.7										
			Surface	1.0	25.8	31.8	31.9	7.21	7.20		106.0	105.8	3.42	3.40		3.5	3.3													
			Gunace	1.0	20.0	31.9	01.0	7.18	7.20	7.13	105.6	100.0	3.38	0.40		3.1	0.0													
04/05/19	1507-1521	25/Cloudy	Middle	10.6	25.5	32.0	32.1	7.04	7.06		103.0	103.2	3.84	3.82	3.73	2.9	2.9	3.1												
		-				32.1		7.07	-		103.4		3.80			2.9														
			Bottom	20.2	25.4	32.2 32.3	32.3	6.91 6.94	6.93	6.93	101.1 101.5	101.3	3.98 3.95	3.97		3.1 3.0	3.1													
						31.6		7.40			101.4		3.35			2.4														
			Surface	1.0	21.8	31.6	31.6	7.43	7.42	7.04	101.8	101.6	3.31	3.33		2.7	2.6													
06/05/19	0830-0844	23/Coludy	Middle	10.7	21.6	31.7	31.7	7.27	7.26	7.34	99.3	99.1	3.52	3.51	3.54	3.1	3.2	2.9												
00/03/19	0830-0844	23/Coludy	Midule	10.7	21.0	31.7	51.7	7.24	7.20		98.9	99.1	3.49	3.51	3.04	3.3	3.2													
			Bottom	20.3	21.5	31.8	31.9	7.11	7.09	7.09	97.0	96.8	3.78	3.77		3.0	3.1													
		-				31.9		7.07			96.5		3.76			3.1														
		21/Cloudy	21/Cloudy	21/Cloudy	21/Cloudy	Surface	1.0	19.7	31.4 31.3	31.4	7.48	7.47		98.4 98.2	98.3	3.55 3.58	3.57		3.2 3.1	3.2										
						21/Cloudy	6 21/Cloudy				31.5		7.32		7.40	96.2		3.66			2.7									
08/05/19	0833-0846							21/Cloudy	21/Cloudy	Middle	10.8	19.6	31.5	31.5	7.35	7.34		96.6	96.4	3.64	3.65	3.68	3.0	2.9	3.3					
			Bottom	20.5	19.4	31.6	31.7	7.19	7.17	7.17	94.2	94.0	3.81	3.83	1	3.6	3.8	1												
								Bollom	20.5	19.4	31.7	51.7	7.15	7.17	7.17	93.7	94.0	3.85	3.65		3.9	3.0								
					Surface	1.0	21.7	31.1	31.2	7.81	7.89		106.5	107.4	3.64	3.67		6.7	6.9											
						31.2		7.97		7.80	108.3		3.70		4	7.0		4												
10/05/19	0813-0830	28/Fine	Middle	10.8	21.5	31.4 31.5	31.5	7.65	7.71		104.1 105.7	104.9	3.52 3.55	3.54	3.50	6.2 6.5	6.4	6.4												
						31.7		7.43			100.9		3.26			6.2														
			Bottom	20.6	21.3	31.7	31.7	7.52	7.48	7.48	102.1	101.5	3.31	3.29		5.8	6.0													
			Surface	1.0	25.5	31.4	31.4	7.56	7.53		110.4	110.0	2.93	2.95		8.9	8.8													
			Surface	1.0	20.0	31.3	51.4	7.50	7.55	7.42	109.5	110.0	2.96	2.95		8.7	0.0													
14/05/19	1321-1340	29/Cloudy	Middle	10.8	25.3	31.6	31.6	7.34	7.31		106.9	106.5	2.85	2.83	2.96	5.1	5.3	6.1												
		,				31.6		7.27			106.0		2.81			5.4														
			Bottom	20.6	25.1	31.8 31.8	31.8	7.16	7.14	7.14	103.9 103.2	103.6	3.11 3.08	3.10		4.4	4.3													
						31.8		7.11			103.2		3.08			4.2														
			Surface	1.0	25.7	31.7	31.7	7.32	7.34		107.3	107.6	3.14	3.13		4.7	4.6													
40/05/40	1538-1555	1538-1555	1538-1555 31/Cloudy	38-1555 31/Cloudy	31/Cloudy M	24/01-01-01-01-01-01-01-01-01-01-01-01-01-0	21/01	31/01	21/01	21/Cloudy	21/Cloudy	21/Cloudy	- 31/Cloudy		Middle	10.0	0F F	31.8	24.0	7.13	7.40	7.25	104.2	101.0	2.94	0.00	2.44	8.1		
16/05/19						Middle	10.9	25.5	31.8	31.8	7.18	(16)		104.2 104.6	2.97	2.96	96 3.11	8.4	8.3	6.5										
			Bottom	20.7	25.3	31.9	32.0	6.96	6.98	6.98	101.3	101.6	3.26	3.24		6.6	6.5	1												
			Dottoin		20.0	32.0	02.0	6.99	0.00	0.00	101.8		3.22	0.2.		6.4	0.0													

# Mid-Flood Tide

#### Monitoring Station : TKO-C1

Date	Sampling	Ambient Temp	Monitorin	ng Depth	Temp	Salini	ty (ppt)	Dissol	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	nded Solids	s (mg/L)
Dale	Duration	(°C) / Weather Condition	n)	ו)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.8	31.9	31.9	7.21	7.23	·	106.0	106.2	3.82	3.84		1.3	1.4	
						31.9 31.9		7.24		7.13	106.4 103.5		3.86 3.97			1.4 2.6		
18/05/19	1600-1614	30/Cloudy	Middle	10.7	25.7	32.0	32.0	7.00	7.03		103.0	103.3	3.92	3.95	3.93	2.8	2.7	1.8
			Bottom	20.4	25.5	32.2	32.2	6.93	6.92	6.92	101.6	101.4	4.02	4.00		1.5	1.5	
						32.2		6.90			101.2		3.98			1.4		
			Surface	1.0	27.9	31.7 31.6	31.7	7.43	7.42		117.1 112.5	114.8	3.65 3.61	3.63		3.0 2.8	2.9	
20/05/19	0829-0842	31/Fine	Middle	10.8	27.7	31.8	31.9	7.27	7.29	7.35	110.3	110.6	3.72	3.73	3.75	2.6	2.8	2.8
20/05/19	0829-0842	3 I/Fine	Middle	10.8	27.7	31.9	31.9	7.31	7.29		110.9	110.6	3.74	3.73	3.75	3.0	2.8	2.8
			Bottom	20.6	27.6	32.0	32.0	7.14	7.13	7.13	108.4	108.2	3.91	3.90		2.8	2.6	
						32.0 31.5		7.12			108.0 106.0		3.88 3.52			2.4 2.9		
			Surface	1.0	22.7	31.5	31.5	7.58	7.60	7.49	105.4	105.7	3.50	3.51		3.4	3.2	
22/05/19	0833-0845	24/Cloudy	Middle	11.0	22.5	31.7	31.7	7.36	7.38	7.49	102.1	102.3	3.64	3.66	3.66	3.2	3.4	2.9
22.00.10		2 // 0.0000	inidalo	1.1.0	22.0	31.6	•	7.39	1.00		102.5	102.0	3.67	0.00	0.00	3.6	0.1	2.0
			Bottom	20.9	22.4	31.8 31.8	31.8	7.27	7.26	7.26	100.7 100.4	100.6	3.83 3.79	3.81		2.0 2.0	2.0	
			Quinfana	1.0	05.4	31.4	24.4	7.77	7.01		113.1	112.0	3.76	0.70		0.5	0.5	
			Surface	1.0	25.4	31.4	31.4	7.84	7.81	7.74	114.1	113.6	3.79	3.78		0.4	0.5	
24/05/19	0827-0842	26/Cloudy	Middle	10.9	25.1	31.6	31.7	7.63	7.68		110.7	111.4	3.59	3.61	3.60	0.3	0.4	0.5
						31.7 31.9		7.72			112.0 108.1		3.63			0.5		
			Bottom	20.8	25.0	31.9	31.9	7.58	7.52	7.52	110.0	109.1	3.44	3.42		0.6	0.5	
			Surface	1.0	25.6	31.0	31.0	7.77	7.79		113.2	113.5	3.76	3.77		3.6	3.6	
						31.0		7.81		7.70	113.8		3.77			3.5		-
27/05/19	1250-1305	27/Cloudy	Middle	10.9	25.3	31.0 31.1	31.1	7.59 7.64	7.62		110.2 110.8	110.5	3.65 3.69	3.67	3.65	10.6 10.1	10.4	5.9
			Bottom	20.7	25.2	31.2	31.3	7.43	7.51	7.51	107.8	108.9	3.50	3.52		3.8	3.9	
			Bollom	20.7	20.2	31.3	51.5	7.58	7.51	7.51	110.0	106.9	3.54	3.52		4.0	3.9	
			Surface	1.0	25.4	31.1 31.1	31.1	7.78	7.83		113.1 114.5	113.8	3.64	3.66		2.3	2.4	
						31.1		7.88		7.73	114.5		3.68			2.5 2.6		
29/05/19	1325-1342	26/Cloudy	Middle	11.0	25.2	31.4	31.4	7.67	7.63		111.3	110.7	3.54	3.53	3.50	3.0	2.8	2.4
			Bottom	20.9	25.0	31.5	31.6	7.45	7.51	7.51	107.8	108.7	3.29	3.31		1.8	1.9	]
						31.6		7.57			109.6		3.33			2.0		
			Surface	1.0	24.7	31.2 31.1	31.2	7.76	7.75		111.5 111.2	111.4	3.70 3.73	3.72		0.7	0.8	
21/05/40	1600 4045	25/01	Middle	10.0	24.0	31.3	24.0	7.65	7.07	7.71	109.9	110.0	3.84	2.00	2.05	2.2	2.2	1 7
31/05/19	1600-1615	25/Cloudy	Middle	10.9	24.6	31.3	31.3	7.69	7.67		110.5	110.2	3.82	3.83	3.85	2.4	2.3	1.7
			Bottom	20.8	24.5	31.4	31.5	7.43	7.45	7.45	106.6	106.8	4.01	3.99		2.2	2.1	
						31.5		7.46		l	107.0		3.97			1.9		

# Mid-Flood Tide

#### Monitoring Station : TKO-M4

Dela	Sampling	Ambient Temp	Monitorin	ng Depth	Temp	Salini	ty (ppt)	Dissolv	ved Oxygen	ı (mg/L)		d Oxygen tion (%)	Т	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Date	Duration	(°C) / Weather Condition	(m	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.0	29.4 29.5	29.5	7.10 7.13	7.12	= 10	101.5 101.8	101.7	3.30 3.34	3.32		4.3 3.9	4.1	
02/05/19	1725-1740	22/Fine	Middle	5.3	24.8	29.6 29.6	29.6	7.22	7.21	7.16	102.8 102.6	102.7	3.47 3.50	3.49	3.29	3.1 3.5	3.3	4.1
			Bottom	9.5	24.6	29.8 29.9	29.9	6.97 6.99	6.98	6.98	99.1 99.4	99.3	3.06 3.09	3.08		4.7	4.8	
			Surface	1.0	25.7	32.0 31.9	32.0	7.39 7.35	7.37		108.5 108.0	108.3	3.39 3.43	3.41		2.6 2.6	2.6	
04/05/19	1616-1629	25/Fine	Middle	4.9	25.6	32.1 32.2	32.2	7.16 7.15	7.16	7.26	105.1 104.8	105.0	3.77 3.70	3.74	3.69	1.6 1.9	1.8	2.4
			Bottom	8.8	25.4	32.3 32.3	32.3	7.05 7.02	7.04	7.04	103.2 102.8	103.0	3.90 3.96	3.93		2.7 3.0	2.9	
			Surface	1.0	21.9	31.7 31.7	31.7	7.47 7.45	7.46	7.41	102.5 102.2	102.4	3.24 3.26	3.25		2.7 3.1	2.9	
06/05/19	0947-1000	23/Cloudy	Middle	4.6	21.7	31.9 31.8	31.9	7.34 7.38	7.36	7.41	100.6 101.0	100.8	3.39 3.36	3.38	3.40	3.8 3.5	3.7	3.3
			Bottom	8.2	21.6	32.0 32.0	32.0	7.19 7.16	7.18	7.18	98.4 98.0	98.2	3.60 3.56	3.58		3.5 3.2	3.4	
			Surface	1.0	19.8	31.4 31.4	31.4	7.57 7.54	7.56	7.47	99.9 99.5	99.7	3.39 3.37	3.38		4.3 4.0	4.2	
08/05/19	0945-1000	21/Cloudy	Middle	4.5	19.6	31.6 31.5	31.6	7.41 7.37	7.39	1.41	97.5 96.9	97.2	3.51 3.54	3.53	3.55	2.9 3.2	3.1	3.7
			Bottom	8.0	19.5	31.7 31.7	31.7	7.24 7.26	7.25	7.25	95.1 95.4	95.3	3.73 3.77	3.75		3.7 4.0	3.9	
			Surface	1.0	21.7	31.1 31.1	31.1	7.78 7.84	7.81	7.70	105.9 106.8	106.4	3.45 3.44	3.45		6.0 6.4	6.2	
10/05/19	0947-1000	28/Fine	Middle	4.9	21.6	31.4 31.4	31.4	7.51 7.66	7.59	-	102.3 104.3	103.3	3.20 3.24	3.22	3.24	5.7 5.2	5.5	6.3
			Bottom	8.7	21.5	31.6 31.7	31.7	7.49 7.38	7.44	7.44	102.0 100.5	101.3	3.03 3.07	3.05		7.2 7.0	7.1	
			Surface	1.0	25.5	31.4 31.4	31.4	7.66 7.69	7.68	7.56	111.8 112.3	112.1	2.88 2.92	2.90		5.0 4.7	4.9	-
14/05/19	1451-1507	29/Cloudy	Middle	4.9	25.4	31.5 31.5	31.5	7.47 7.41	7.44		108.8 108.1	108.5	2.76 2.78	2.77	2.90	5.2 5.0	5.1	6.2
			Bottom	8.7	25.3	31.6 31.5	31.6	7.28 7.23	7.26	7.26	106.1 105.4	105.8	3.06 3.02	3.04		8.6 8.9	8.8	
			Surface	1.0	25.6	31.7 31.6	31.7	7.40 7.35	7.38	7.32	108.5 107.8	108.2	3.09 3.06	3.08		5.1 4.9	5.0	
16/05/19	1704-1719	31/Cloudy	Middle	4.9	25.5	31.8 31.7	31.8	7.22 7.29	7.26		105.5 106.5	106.0	2.86 2.82	2.84	3.03	6.2 6.4	6.3	6.6
			Bottom	8.8	25.4	31.9 31.9	31.9	7.07 7.01	7.04	7.04	103.1 102.3	102.7	3.18 3.15	3.17		8.6 8.2	8.4	

# Mid-Flood Tide

#### Monitoring Station : TKO-M4

Dete	Sampling	Ambient Temp	Monitorin	ng Depth	Temp	Salini	ty (ppt)	Dissolv	ved Oxyger	(mg/L)		d Oxygen tion (%)	Т	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Date	Duration	(°C) / Weather Condition	(m	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.8	32.0 32.0	32.0	7.29 7.26	7.28		107.2 106.8	107.0	3.61 3.65	3.63		1.2 1.6	1.4	
						32.0		7.20		7.18	106.8		3.78			2.0		
18/05/19	1708-1724	30/Cloudy	Middle	5.1	25.6	32.1	32.1	7.07	7.09		103.6	103.9	3.75	3.77	3.79	1.7	1.9	2.0
			Dettern	9.2	05.0	32.1	22.4	7.01	6.99	6.99	102.9	102.7	3.99	2.07		3.0	2.9	
			Bottom	9.2	25.6	32.1	32.1	6.97	6.99	6.99	102.4	102.7	3.95	3.97		2.7	2.9	
			Surface	1.0	27.8	31.8	31.8	7.46	7.47		117.4	115.6	3.40	3.41		2.9	2.9	
						31.8		7.48		7.42	113.7		3.42			2.9		
20/05/19	0942-0955	31/Fine	Middle	5.2	27.6	31.9	32.0	7.39	7.38		112.0	111.9	3.57	3.55	3.55	2.8	3.0	2.9
						32.0 32.1		7.36 7.23			111.7		3.53 3.67			3.2		
			Bottom	9.4	27.5	32.1	32.1	7.23	7.21	7.21	109.6 108.9	109.3	3.67	3.69		3.0 2.8	2.9	
						31.4		7.63			106.3		3.28			2.8		
			Surface	1.0	22.8	31.4	31.4	7.66	7.65		106.7	106.5	3.31	3.30		2.4	2.3	
00/05/40	0040.0057		Middle	5.0	22.7	31.5	31.5	7.43	7.44	7.54	103.3	103.5	3.46	3.45	3.44	2.3	2.4	2.8
22/05/19	0943-0957	24/Cloudy	Middle	5.3	22.1	31.5	31.5	7.45	7.44		103.6	103.5	3.44	3.45	3.44	2.5	2.4	2.8
			Bottom	9.6	22.5	31.7	31.7	7.38	7.36	7.36	102.4	102.1	3.55	3.57		3.8	3.6	
			Dottoini	0.0	22.0	31.6	01.7	7.34	7.00	7.00	101.8	102.1	3.59	0.07		3.4	0.0	
			Surface	1.0	25.4	31.3	31.4	7.81	7.89		113.6	114.7	3.42	3.40		0.8	0.8	
						31.4		7.96		7.80	115.8		3.37			0.7		
24/05/19	0948-1000	26/Cloudy	Middle	4.8	25.3	31.6 31.6	31.6	7.69 7.75	7.72		111.9 112.8	112.4	3.26 3.29	3.28	3.27	0.4 0.5	0.5	0.6
						31.8		7.40			107.5		3.14			0.5		
			Bottom	8.6	25.1	31.9	31.9	7.31	7.36	7.36	106.2	106.9	3.15	3.15		0.7	0.7	
			0	4.0	05.0	31.0	04.0	7.68	4		111.9	110.0	3.40	0.40		3.8	0.7	
			Surface	1.0	25.6	31.0	31.0	7.79	7.74	7.62	113.6	112.8	3.43	3.42		3.5	3.7	
27/05/19	1423-1441	27/Cloudy	Middle	4.8	25.5	31.1	31.1	7.43	7.50	7.02	108.1	109.1	3.24	3.25	3.27	5.1	5.4	5.0
2.700.10	1120 1111	Zholoddy	inidalo		20.0	31.1	•	7.57			110.1		3.26	0.20	0.21	5.6	0.1	0.0
			Bottom	8.6	25.4	31.3	31.3	7.22	7.30	7.30	105.0	106.2	3.10	3.13		6.2	6.0	
						31.3		7.38			107.4		3.16			5.8		
			Surface	1.0	25.4	31.1 31.0	31.1	7.65 7.76	7.71		111.1 112.7	111.9	3.51 3.54	3.53		2.3 2.1	2.2	
						31.0		7.53		7.66	109.4		3.62		-	4.8		
29/05/19	1502-1519	26/Cloudy	Middle	5.0	25.3	31.4	31.4	7.68	7.61		111.6	110.5	3.63	3.63	3.55	4.5	4.7	3.2
					0 <b>.</b>	31.5		7.50			108.7	100.0	3.47			3.0		
			Bottom	8.9	25.1	31.6	31.6	7.66	7.58	7.58	111.0	109.9	3.50	3.49		2.6	2.8	
			Surface	1.0	24.8	31.1	31.1	7.85	7.83		113.0	112.7	3.57	3.56		1.5	1.6	
			Sunace	1.0	24.0	31.1	51.1	7.81	1.00	7.76	112.4	112.1	3.55	0.00		1.7	1.0	
31/05/19	1720-1734	25/Cloudy	Middle	4.9	24.6	31.3	31.3	7.67	7.69		110.2	110.4	3.66	3.64	3.67	1.4	1.3	1.4
				-	-	31.3		7.70			110.6		3.62			1.1	-	
			Bottom	8.7	24.4	31.5	31.5	7.55	7.54	7.54	108.2	108.1	3.81	3.80		1.5	1.4	
						31.4		7.53			107.9		3.78			1.2		

### Mid-Ebb Tide



#### Monitoring Station : TKO-C1

Date	Sampling	Ambient Temp	Monitorin	ig Depth	Temp	Salini	ty (ppt)	Dissolv	ved Oxygen	ı (mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Dale	Duration	(°C) / Weather Condition	(n	ו)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.0	29.4 29.5	29.5	6.89 6.92	6.91		98.5 98.7	98.6	3.30 3.27	3.29		4.6 5.0	4.8	
02/05/19	1030-1045	22/Fine	Middle	11.2	24.7	29.7 29.7	29.7	7.12 7.15	7.14	7.02	101.4 101.7	101.6	3.40 3.47	3.44	3.35	4.8 5.2	5.0	4.6
			Bottom	21.3	24.6	29.8 29.9	29.9	7.03	7.05	7.05	100.0 100.3	100.2	3.33 3.30	3.32		3.7 4.0	3.9	
			Surface	1.0	25.3	31.9 31.9	31.9	7.14	7.16		104.0 104.4	104.2	3.73 3.70	3.72		3.4 3.4	3.4	
04/05/19	1008-1022	24/Cloudy	Middle	10.4	25.2	32.2 32.3	32.3	7.05	7.03	7.09	102.7	102.4	3.92 3.95	3.94	3.90	1.4 1.6	1.5	2.1
			Bottom	19.9	25.2	32.3 32.4	32.4	6.96 6.92	6.94	6.94	101.6 101.0	101.3	4.07	4.06		1.5 1.5	- 1.5	
			Surface	1.0	20.7	31.7 31.6	31.7	7.26	7.24		97.5 96.9	97.2	3.56 3.58	3.57		3.1 2.7	2.9	
06/05/19	1316-1331	22/Cloudy	Middle	10.6	20.5	31.8 31.8	31.8	7.05	7.07	7.15	94.4 94.8	94.6	3.77 3.73	3.75	3.74	5.1 5.0	5.1	3.6
			Bottom	20.1	20.4	32.0 31.9	32.0	6.95 6.93	6.94	6.94	93.0 92.7	92.9	3.92 3.89	3.91		2.7 3.0	2.9	
			Surface	1.0	20.9	31.3 31.3	31.3	7.35 7.39	7.37		98.8 99.3	99.1	3.74 3.71	3.73		4.3 4.5	4.4	
08/05/19	1335-1349	22/Cloudy	Middle	10.7	20.7	31.5 31.4	31.5	7.17	7.16	7.27	96.2 95.8	96.0	3.83 3.85	3.84	3.87	3.2 3.4	3.3	3.6
			Bottom	20.3	20.5	31.6 31.6	31.6	7.06	7.05	7.05	94.4 94.0	94.2	4.03	4.05		3.4 3.1 3.0	- 3.1	-
			Surface	1.0	21.8	31.1 31.1	31.1	7.66	7.56		104.6 101.7	103.2	3.84 3.80	3.82		4.8 4.1	4.5	
10/05/19	1520-1537	29/Fine	Middle	10.7	21.6	31.3 31.4	31.4	7.32	7.37	7.46	99.7 100.9	100.3	3.63 3.67	3.65	3.67	4.1 5.1 5.5	5.3	5.6
			Bottom	20.4	21.3	31.5 31.6	31.6	7.19	7.23	7.23	97.5 98.6	98.1	3.54 3.55	3.55		6.9 7.4	7.2	
			Surface	1.0	25.3	31.5 31.5	31.5	7.38	7.35		107.5 106.7	107.1	3.07 3.05	3.06		4.3	4.6	
14/05/19	0833-0850	17/Cloudy	Middle	10.6	25.2	31.8 31.7	31.8	7.16	7.18	7.27	104.2 104.8	104.5	3.23 3.19	3.21	3.08	5.6 5.2	- 5.4	5.5
			Bottom	20.2	25.0	31.9 32.0	32.0	7.04	7.07	7.07	101.9 102.7	102.3	2.98	2.96		6.2 6.6	6.4	
			Surface	1.0	25.5	31.8 31.7	31.8	7.23 7.18	7.21		105.6 104.9	105.3	3.24 3.21	3.23		5.5 6.0	5.8	
16/05/19	0932-0950	29/Cloudy	Middle	10.7	25.3	31.9 31.9	31.9	7.06	7.03	7.12	102.8 101.9	102.4	3.16 3.12	3.14	3.26	5.5 5.2	5.4	5.5
			Bottom	20.3	25.2	32.0 32.1	32.1	6.87 6.82	6.85	6.85	99.8 99.2	99.5	3.39 3.42	3.41		5.2 5.5	5.4	

### Mid-Ebb Tide



#### Monitoring Station : TKO-C1

Date	Sampling	Ambient Temp	Monitorin	ig Depth	Temp	Salini	ty (ppt)	Dissolv	ved Oxygen	n (mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	nded Solids	(mg/L)
Date	Duration	(°C) / Weather Condition	(n	ו)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.6	31.8 31.9	31.9	7.05 7.01	7.03		103.2 102.6	102.9	4.04 4.02	4.03		1.0 0.9	1.0	Ĩ
18/05/19	1054-1108	30/Cloudy	Middle	10.4	25.5	31.9 32.0	32.0	6.93 6.90	6.92	6.97	101.4	101.2	4.17	4.16	4.14	1.8 2.1	2.0	1.6
			Bottom	19.8	25.4	32.0 32.1 32.2	32.2	6.82	6.81	6.81	99.7 99.3	99.5	4.14	4.23		1.9	1.8	
			Surface	1.0	28.8	31.6	31.6	6.79 7.29	7.31		112.5	112.8	3.74	3.76		1.7 2.8	2.9	
20/05/19	1313-1327	32/Fine	Middle	10.7	28.6	31.6 31.8	31.8	7.32 7.19	7.17	7.24	113.0 110.8	110.4	3.78 3.93	3.92	3.93	3.0 6.8	7.1	5.4
			Bottom	20.3	28.5	31.7 31.9	31.9	7.15 7.02	7.03	7.03	110.0 108.0	108.2	3.90 4.11	4.10		7.3 6.4	6.2	-
			Surface	1.0	25.7	31.9 31.5	31.5	7.04 7.49	7.48	1.00	108.3 109.7	109.6	4.09 3.63	3.62		5.9 4.1	4.1	
						31.4 31.6		7.47 7.28		7.39	109.4 106.3		3.61 3.85			4.0 2.6		
22/05/19	1333-1348	28/Fine	Middle	10.9	25.5	31.6 31.7	31.6	7.31 7.16	7.30		106.7 104.5	106.5	3.88 4.01	3.87	3.83	2.5 2.8	2.6	3.2
			Bottom	20.7	25.4	31.7 31.3	31.7	7.12	7.14	7.14	103.9 111.0	104.2	3.97 3.84	3.99		3.1 0.1	3.0	
			Surface	1.0	25.5	31.4	31.4	7.73	7.67	7.59	112.9	112.0	3.89	3.87		0.2	0.2	
24/05/19	1503-1518	27/Cloudy	Middle	10.8	25.2	31.6 31.6	31.6	7.45 7.55	7.50		108.2 109.7	109.0	3.71 3.75	3.73	3.75	1.0 1.3	1.2	0.7
			Bottom	20.5	25.0	31.7 31.8	31.8	7.30 7.43	7.37	7.37	105.8 107.6	106.7	3.62 3.66	3.64		0.6 0.8	0.7	
			Surface	1.0	25.4	31.0 31.0	31.0	7.45 7.55	7.50	7.44	108.2 109.7	109.0	3.89 3.80	3.85		5.2 5.5	5.4	
27/05/19	0851-0903	26/Cloudy	Middle	10.8	25.2	31.1 31.2	31.2	7.41 7.34	7.38	1.44	107.3 106.3	106.8	3.74 3.77	3.76	3.73	4.5 4.2	4.4	4.3
			Bottom	20.5	25.1	31.4 31.4	31.4	7.20 7.26	7.23	7.23	104.3 105.2	104.8	3.56 3.59	3.58		3.2 3.4	3.3	
			Surface	1.0	25.3	31.1 31.0	31.1	7.56 7.64	7.60		109.7 110.8	110.3	3.84 3.89	3.87		4.6 4.5	4.6	
29/05/19	0906-0922	25/Cloudy	Middle	10.8	25.1	31.3 31.4	31.4	7.44 7.30	7.37	7.49	107.8 105.8	106.8	3.72 3.77	3.75	3.75	3.3 3.4	3.4	3.9
			Bottom	20.6	25.0	31.5 31.6	31.6	7.26	7.31	7.31	105.1 100.3	102.7	3.61 3.65	3.63		3.8	3.8	
			Surface	1.0	26.8	31.1 31.1	31.1	7.55	7.57		112.4 113.0	112.7	3.84 3.81	3.83		1.2 1.2	1.2	
31/05/19	0944-1000	27/Cloudy	Middle	10.8	26.7	31.2 31.3	31.3	7.38	7.37	7.47	109.8 109.5	109.7	3.96 4.00	3.98	3.98	1.2 1.5 1.8	1.7	1.5
			Bottom	20.5	26.5	31.3 31.4 31.4	31.4	7.24	7.26	7.26	109.5 107.4 107.9	107.7	4.13	4.12		1.8 1.4 1.7	1.6	

### Mid-Ebb Tide

#### Monitoring Station : TKO-M4

Date	Sampling	Ambient Temp (°C) / Weather	Monitoring [	)enth (m)	Temp	Salini	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	nded Solids	s (mg/L)
Dale	Duration	Condition	wormoring t	Septir (III)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	24.9	29.5 29.6	29.6	7.14 7.17	7.16		102.1 102.4	102.3	3.11 3.14	3.13		3.2 3.5	3.4	
02/05/19	1155-1215	22/Fine	Middle	5.1	24.7	29.8	29.8	7.30	7.32	7.24	103.9	104.1	3.25	3.27	3.26	4.2	4.1	4.3
			Bottom	9.2	24.5	29.7 29.9	30.0	7.33 6.91	6.93	6.93	104.2 98.3	- 98.5	3.28 3.37	3.39		4.0 5.1	5.3	
					25.4	30.0 32.0		6.94 7.30			98.6 106.7	106.5	3.40 3.66			5.5 3.1	2.9	
			Surface	1.0		32.1 32.3	32.1	7.27 7.19	7.29	7.23	106.3 105.1		3.69 3.80	3.68		2.7 1.9		-
04/05/19	1119-1131	24/Cloudy	Middle	4.4	25.3	32.3	32.3	7.15	7.17		104.6	104.9	3.84	3.82	3.79	1.8	1.9	2.4
			Bottom	7.8	25.3	32.4 32.4	32.4	7.02 6.98	7.00	7.00	102.6 102.1	102.4	3.88 3.84	3.86		2.4 2.2	2.3	
			Surface	1.0	20.8	31.8 31.8	31.8	7.30 7.33	7.32	7.26	98.3 98.7	98.5	3.47 3.44	3.46		3.3 3.4	3.4	
06/05/19	1433-1448	22/Cloudy	Middle	4.5	20.7	32.0 31.9	32.0	7.22 7.18	7.20	7.20	97.2 96.5	96.9	3.55 3.59	3.57	3.59	2.6 2.5	2.6	2.9
			Bottom	7.9	20.5	32.1 32.1	32.1	7.07	7.08	7.08	94.9 95.2	95.1	3.76 3.74	3.75		3.0	2.9	
			Surface	1.0	20.7	31.3	31.4	7.45	7.44		99.9	99.8	3.44	3.46		2.7 3.4	3.3	
08/05/19	1452-1505	22/Cloudy	Middle	4.4	20.6	31.4 31.5	31.5	7.43 7.30	7.28	7.36	99.6 97.7	97.5	3.48 3.71	3.70	3.68	3.2 3.9	3.8	3.4
00,00,10	1.02 1000	0.0000y				31.5 31.7		7.26 7.10		7.40	97.2 94.8		3.69 3.87			3.7 2.9		
			Bottom	7.7	20.4	31.6 31.1	31.7	7.13 7.43	7.12	7.12	95.2 101.5	95.0	3.90 3.57	3.89		3.2 5.2	3.1	
			Surface	1.0	21.8	31.1	31.1	7.57	7.50	7.39	103.4	102.5	3.54	3.56		5.0	5.1	-
10/05/19	1656-1717	29/Fine	Middle	4.7	21.7	31.3 31.4	31.4	7.20 7.34	7.27		98.3 100.2	99.3	3.34 3.39	3.37	3.39	5.3 5.9	5.6	5.8
			Bottom	8.4	21.6	31.6 31.6	31.6	7.25 7.15	7.20	7.20	98.9 97.5	98.2	3.22 3.25	3.24		6.7 6.4	6.6	
			Surface	1.0	25.3	31.5 31.6	31.6	7.45 7.40	7.43		108.5 107.8	108.2	2.98 3.01	3.00		4.5 4.5	4.5	
14/05/19	0948-1000	27/Cloudy	Middle	4.7	25.2	31.7 31.7	31.7	7.27	7.29	7.36	105.8 106.2	106.0	2.86	2.84	3.00	5.0 5.0	5.0	5.4
			Bottom	8.4	25.2	31.8	31.8	7.15	7.13	7.13	104.0	103.8	3.17	3.16		6.9	6.7	-
			Surface	1.0	25.5	31.8 31.7	31.7	7.11 7.20	7.28		103.5 106.5	107.0	3.15 3.16	3.18		6.5 4.4	4.5	
16/05/10	1059 1114	20/Cloudy				31.7 31.8		7.36 7.17		7.21	107.5 104.5		3.20 3.34		3.19	4.5 5.2		4.0
16/05/19	1058-1114	29/Cloudy	Middle	4.8	25.4	31.8 31.9	31.8	7.11 6.95	7.14		103.7 101.2	104.1	3.31 3.07	3.33	3.19	4.8 5.0	5.0	4.9
			Bottom	8.5	25.3	31.9	31.9	6.90	6.93	6.93	100.5	100.9	3.05	3.06		5.3	5.2	

### Mid-Ebb Tide

#### Monitoring Station : TKO-M4


Date	Sampling	Ambient Temp (°C) / Weather	Monitoring D	)enth (m)	Temp	Salinit	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	nded Solids	s (mg/L)
Date	Duration	Condition	Mornitoring L	eptin (iii)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.7	31.9 32.0	32.0	7.17 7.19	7.18		105.2 105.5	105.4	3.94 3.98	3.96		1.6 1.6	1.6	
18/05/19	1205-1218	30/Cloudy	Middle	4.6	25.6	32.0	32.0	7.01	7.03	7.10	102.7	102.9	4.05	4.03	4.02	1.3	1.3	1.4
		· · · · · · · · · · · · · · · · · · ·				32.0 32.0		7.04 6.98			103.1 102.2		4.01			1.2 1.5		-
			Bottom	8.2	25.5	32.1	32.1	6.95	6.97	6.97	101.8	102.0	4.06	4.08		1.4	1.5	
			Surface	1.0	28.7	31.7 31.7	31.7	7.36 7.34	7.35		113.4 113.1	113.3	3.55 3.53	3.54		2.8 2.6	2.7	
20/05/19	1432-1446	32/Fine	Middle	5.1	28.6	31.9	31.9	7.22	7.21	7.28	111.3	111.1	3.66	3.68	3.68	2.8	2.6	3.0
20/00/10	1102 1110	021 mo	Middle	0.1	20.0	31.8 32.0	01.0	7.19 7.07	7.21		110.8 108.6		3.69 3.83	0.00	0.00	2.4	2.0	0.0
			Bottom	9.1	28.4	32.0	32.0	7.07	7.09	7.09	108.6	108.9	3.79	3.81		3.9 3.6	3.8	
			Surface	1.0	25.9	31.5 31.5	31.5	7.54 7.50	7.52		110.9	110.6	3.39 3.36	3.38		2.3	2.5	
22/05/19	1452-1505	28/Fine	Middle	5.2	25.7	31.5	31.6	7.50	7.35	7.43	110.3 107.9	107.7	3.36	3.50	3.53	2.6 3.8	4.0	3.0
22/05/19	1452-1505	28/Fine	Middle	5.2	25.7	31.6	31.0	7.33	7.35		107.5	107.7	3.48	3.50	3.53	4.1	4.0	3.0
			Bottom	9.3	25.5	31.8 31.7	31.8	7.21 7.23	7.22	7.22	105.4 105.7	105.6	3.70 3.72	3.71		2.7 2.4	2.6	
			Surface	1.0	25.5	31.3 31.4	31.4	7.65 7.54	7.60		111.6 110.0	110.8	3.56 3.59	3.58		0.6 0.4	0.5	
24/05/19	1626-1638	27/Cloudy	Middle	4.6	25.4	31.4	31.6	7.39	7.43	7.51	107.7	108.3	3.26	3.28	3.35	0.4	0.3	0.8
24/03/13	1020-1030	21/010000	Middle	4.0	20.4	31.6	01.0	7.47 7.26	7.40		108.8 105.2	100.0	3.30 3.17	0.20	0.00	0.3	0.0	0.0
			Bottom	8.2	25.2	31.8 31.8	31.8	7.20	7.31	7.31	105.2	105.9	3.17	3.19		1.7 1.5	1.6	
			Surface	1.0	25.4	31.0	31.0	7.56 7.41	7.49		109.9	108.8	3.55	3.56		4.8	5.0	
27/05/19	1000 1005	00/Olaudu	Middle	4.7	25.4	31.0 31.1	31.1	7.41	7.30	7.39	107.7 106.5	106.1	3.57 3.34	3.36	3.37	5.2 5.3	5.2	4.7
27/05/19	1009-1025	26/Cloudy	Middle	4.7	25.4	31.1	31.1	7.27	7.30		105.6	106.1	3.38	3.30	3.37	5.1	5.2	4.7
			Bottom	8.3	25.3	31.3 31.4	31.4	7.22 7.10	7.16	7.16	104.9 103.2	104.1	3.16 3.19	3.18		4.0 3.8	3.9	
			Surface	1.0	25.3	31.1 31.1	31.1	7.58 7.69	7.64		110.0	110.8	3.62 3.66	3.64		2.7	2.6	
29/05/19	1010 1000	05/Olaudu	Middlo	4.8	25.2	31.1 31.4	31.4	7.69	7 57	7.60	111.6 109.0	109.8	3.66	2 55	3.50	2.4 1.4	1.5	2.0
29/05/19	1018-1026	25/Cloudy	Middle	4.8	25.2	31.4	31.4	7.62	7.57		110.6	109.8	3.57	3.55	3.50	1.6	1.5	2.0
			Bottom	8.6	25.1	31.5 31.6	31.6	7.38 7.47	7.43	7.43	106.9 108.2	107.6	3.29 3.34	3.32		1.9 1.9	1.9	
			Surface	1.0	26.7	31.2	31.2	7.66	7.65		114.0	113.8	3.64	3.66		1.7	1.9	
04/05/10	1105 1101	07/01		4.5	00 -	31.2 31.4		7.63 7.51	7 -0	7.58	113.5 111.4	4410	3.68 3.75	0 =0	0 = 0	2.0 0.9	4.2	
31/05/19	1105-1121	27/Cloudy	Middle	4.8	26.5	31.3	31.4	7.53	7.52		111.7	111.6	3.77	3.76	3.78	1.0	1.0	1.5
			Bottom	8.5	26.4	31.5 31.5	31.5	7.35 7.31	7.33	7.33	108.9 108.3	108.6	3.94 3.91	3.93		1.5 1.8	1.7	




Appendix D3

**Graphical Plots of Impact Marine Water Quality Monitoring Data** 



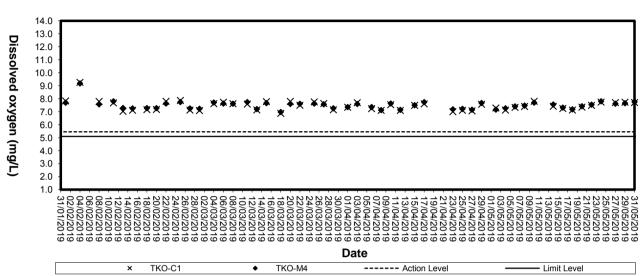


Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide

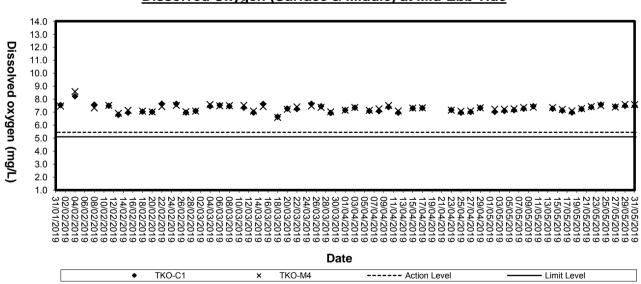


Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide



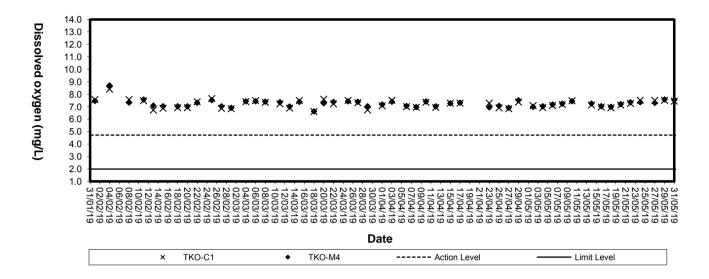


### Dissolved Oxygen (Bottom) at Mid-Flood Tide




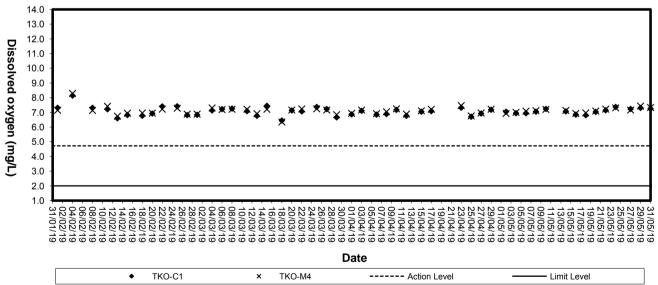




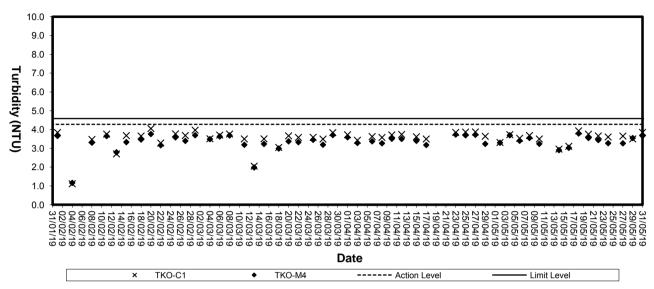


Turbidity (Depth-average) at Mid-Flood Tide




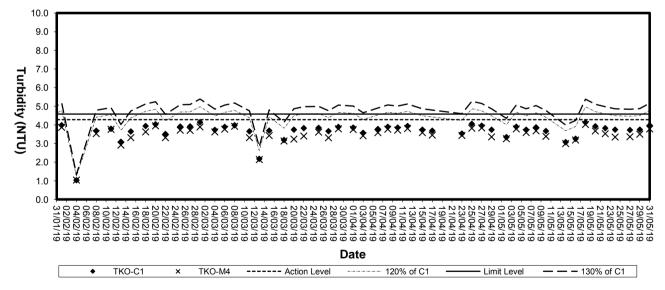



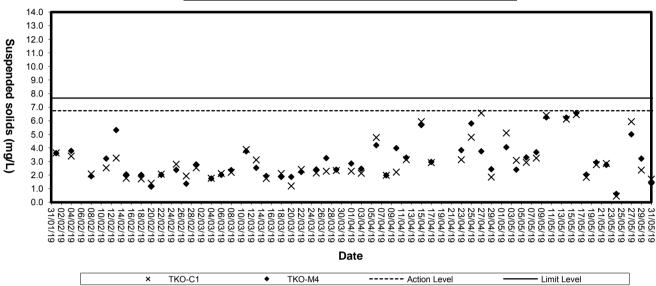

Suspended solids (Depth-average) at Mid-Flood Tide

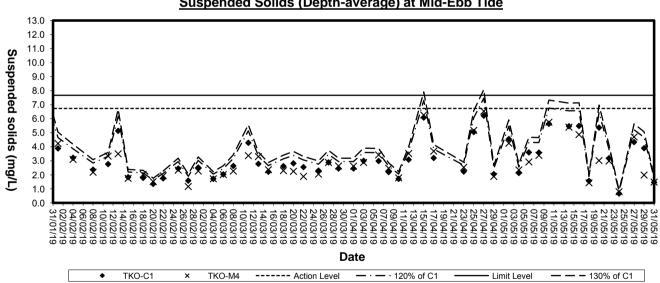

Suspended Solids (Depth-average) at Mid-Ebb Tide



Appendix D4

Impact Marine Water Quality Monitoring Results (3RS Project)

# Mid-Flood Tide

#### Monitoring Station : TKO-C1a

Date	Sampling	Ambient Temp	Monitorir	ng Depth	Temp	Salini	ty (ppt)	Dissol	ved Oxyger	ı (mg/L)		d Oxygen tion (%)	Tu	urbidity (NT	U)	Susper	nded Solids	s (mg/L)
Dale	Duration	(°C) / Weather Condition	(n	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.0	29.4	29.5	6.94	6.96		99.2	99.4	3.77	3.78		3.2	3.5	
						29.6 29.7		6.97 7.13		7.05	99.5 101.5		3.79 3.80			3.7 4.0		
02/05/19	1620-1640	22/Fine	Middle	11.1	24.8	29.7	29.7	7.16	7.15		101.8	101.7	3.84	3.82	3.82	4.3	4.2	4.4
			Bottom	21.1	24.6	29.8	29.9	7.24	7.23	7.23	102.9	102.8	3.86	3.86		5.8	5.5	
						29.9		7.22			102.7		3.86			5.1		
			Surface	1.0	25.8	32.0 32.0	32.0	7.07	7.06		103.9 103.5	103.7	3.37 3.31	3.34		3.2 3.8	3.5	
04/05/40	4505 4500		Malalla	40.0	05.0	32.3		6.97	0.00	7.01	103.3	400.0	3.94	0.00	0.74	2.4		
04/05/19	1525-1539	25/Cloudy	Middle	10.6	25.6	32.2	32.3	6.95	6.96		102.0	102.2	3.90	3.92	3.74	2.3	2.4	2.6
			Bottom	20.2	25.4	32.4	32.4	6.90	6.92	6.92	101.0	101.2	3.98	3.97		2.1	2.0	
						32.4 31.6		6.93 7.33			101.4 100.4		3.95 3.29			1.8	1	
			Surface	1.0	21.8	31.0	31.7	7.36	7.35		100.4	100.6	3.29	3.28		2.7 2.5	2.6	
06/05/19	0848-0902	23/Cloudy	Middle	10.5	21.7	31.8	31.8	7.18	7.16	7.25	98.2	98.0	3.41	3.43	3.42	2.0	2.2	2.4
06/05/19	0040-0902	23/Cloudy	wildule	10.5	21.7	31.8	31.0	7.14	7.10		97.7	90.0	3.44	3.43	3.42	2.3	2.2	2.4
			Bottom	20.0	21.5	31.9	31.9	7.01	7.02	7.02	95.6	95.8	3.58	3.56		2.2	2.4	
						31.9 31.3		7.03			95.9 97.9	-	3.54 3.35			2.5 4.0	-	
			Surface	1.0	19.8	31.3	31.3	7.40	7.42	7.05	97.5	97.7	3.33	3.34		3.7	3.9	
08/05/19	0850-0904	21/Cloudy	Middle	10.5	19.7	31.5	31.5	7.27	7.28	7.35	95.8	95.9	3.45	3.47	3.49	2.3	2.7	3.3
00/00/10	0000 0001	2 holoddy	Wildule	10.0	10.7	31.4	01.0	7.29	1.20		95.9	00.0	3.49	0.17	0.10	3.0	2	0.0
			Bottom	19.9	19.6	31.6 31.6	31.6	7.12	7.10	7.10	93.7 93.2	93.5	3.66	3.65		3.5 3.4	3.5	
						31.0		7.69			104.9		3.50			3.4		
			Surface	1.0	21.7	31.2	31.2	7.78	7.74	7.60	106.1	105.5	3.54	3.52		3.3	3.4	
10/05/19	0834-0850	28/Fine	Middle	10.7	21.5	31.4	31.4	7.52	7.47	7.00	102.3	101.6	3.34	3.37	3.40	4.1	4.2	4.0
				-		31.4		7.41			100.8		3.39			4.2		
			Bottom	20.4	21.3	31.6 31.7	31.7	7.28	7.32	7.32	98.9 100.0	99.5	3.30 3.32	3.31		4.5 4.3	4.4	
			0.1	1.0	05.5	31.4		7.47	7.45		109.1	400 7	2.98	0.01		3.7	0.7	
			Surface	1.0	25.5	31.4	31.4	7.42	7.45	7.34	108.3	108.7	3.04	3.01		3.6	3.7	
14/05/19	1344-1401	29/Cloudy	Middle	10.8	25.3	31.6	31.7	7.26	7.23		105.8	105.4	3.18	3.17	3.00	4.8	4.7	4.3
						31.7 31.8		7.20			104.9 102.7		3.15 2.86			4.5 4.7	1	
			Bottom	20.5	25.1	31.8	31.8	7.07	7.04	7.04	102.7	102.3	2.80	2.84		4.7	4.6	
			Surface	1.0	25.7	31.7	21.7	7.24	7 27		106.2	106.6	3.26	2.24		3.8	4.0	
			Surface	1.0	20.7	31.6	31.7	7.30	7.27	7.17	107.0	100.0	3.22	3.24		4.1	4.0	
16/05/19	1557-1617	31/Cloudy	Middle	10.8	25.5	31.9	31.9	7.08	7.06		103.4	103.2	3.04	3.03	3.22	2.9	3.1	4.6
						31.8 32.0		7.04 6.86			102.9 99.8		3.01 3.37			3.3 7.0		
			Bottom	20.6	25.3	32.0	32.0	6.80	6.83	6.83	99.8 99.1	99.5	3.37	3.38		6.2	6.6	
		L	1		1	02.0	1	0.00	1	1	00.1	1	0.00	1	1	0.2	1	

# Mid-Flood Tide

#### Monitoring Station : TKO-C1a

Date	Sampling	Ambient Temp	Monitorin	ng Depth	Temp	Salini	ty (ppt)	Dissol	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Dale	Duration	(°C) / Weather Condition	n)	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.8	32.0 32.1	32.1	7.15 7.11	7.13		105.1 104.6	104.9	3.42 3.46	3.44		2.3 2.1	2.2	
18/05/19	1618-1632	30/Cloudy	Middle	10.6	25.6	32.1	32.2	6.92	6.91	7.02	104.0	101.4	3.90	3.88	3.75	1.2	1.4	1.6
10/00/10	1010-1032	Sorcioudy	windlic	10.0	20.0	32.1	52.2	6.89	0.01		101.2	101.4	3.85	0.00	0.70	1.5	1.4	1.0
			Bottom	20.2	25.5	32.2 32.3	32.3	6.81 6.84	6.83	6.83	99.8 100.3	100.1	3.94 3.90	3.92		1.4 1.2	1.3	
			Surface	1.0	27.9	31.7 31.7	31.7	7.35 7.37	7.36		111.9 112.2	112.1	3.33 3.31	3.32		3.1	3.0	
20/05/19	0947 0002	31/Fine	Middle	10.9	27.8	31.7	31.9	7.37	7.17	7.27	112.2	109.0	3.31	2.42	3.47	2.8 2.0	2.1	
20/05/19	0847-0902	3 I/Fine	Middle	10.8	27.8	31.8	31.9	7.16	7.17		108.8	109.0	3.45	3.43	3.47	2.2	2.1	2.3
			Bottom	20.5	27.7	32.0 32.1	32.1	7.05	7.04	7.04	107.1 106.7	106.9	3.68 3.65	3.67		1.8 2.0	1.9	
			Surface	1.0	22.8	31.4	31.5	7.59	7.58		105.7	105.6	3.30	3.29		2.5	2.6	
			Guilado		22.0	31.5	00	7.57		7.50	105.4	100.0	3.27	0.20		2.7	2.0	-
22/05/19	0849-0902	24/Cloudy	Middle	10.8	22.6	31.6 31.6	31.6	7.41	7.43		103.9 103.3	103.6	3.45 3.43	3.44	3.44	2.8 2.4	2.6	2.5
			Bottom	20.6	22.4	31.7	31.8	7.28 7.32	7.30	7.30	100.8	101.1	3.61 3.57	3.59		2.5	2.4	
						31.8 31.4		7.32			101.4 113.3		3.57			2.2 1.4		
			Surface	1.0	25.4	31.3	31.4	7.84	7.81	7.70	114.1	113.7	3.68	3.67		1.5	1.5	
24/05/19	0846-0902	26/Cloudy	Middle	11.0	25.1	31.7 31.7	31.7	7.52	7.59	-	109.1 111.1	110.1	3.54 3.58	3.56	3.56	1.4 1.3	1.4	1.4
			Bottom	20.9	25.0	31.9	31.9	7.49	7.53	7.53	108.7	109.3	3.43	3.46		1.2	1.3	
						31.9 31.0		7.57 7.64			109.8 111.4		3.49 3.69			1.4 2.0		
			Surface	1.0	25.6	31.0	31.0	7.81	7.73	7.76	113.8	112.6	3.73	3.71		1.9	2.0	
27/05/19	1309-1324	27/Cloudy	Middle	10.9	25.3	31.1 31.1	31.1	7.75	7.80	1.10	112.4 113.7	113.1	3.52 3.55	3.54	3.57	3.1 3.5	3.3	2.0
			Bottom	20.7	25.2	31.3	31.3	7.66	7.60	7.60	111.1	110.2	3.46	3.48		0.7	0.8	
						31.2 31.1		7.53			109.2 111.8		3.49 3.65			0.8 1.7		
			Surface	1.0	25.4	31.1	31.1	7.79	7.74	7.66	113.2	112.5	3.69	3.67		2.0	1.9	_
29/05/19	1346-1402	26/Cloudy	Middle	10.9	25.2	31.4 31.3	31.4	7.65 7.51	7.58		110.8 109.0	109.9	3.60 3.64	3.62	3.61	2.3 2.1	2.2	2.1
			Bottom	20.8	25.0	31.6	31.6	7.36	7.42	7.42	106.6	107.5	3.53	3.55		2.5	2.4	1
					<del>.</del>	31.6 31.2		7.48 7.68			108.4 110.3		3.56 3.63			2.2 1.9		
			Surface	1.0	24.7	31.2	31.2	7.72	7.70	7.63	110.9	110.6	3.61	3.62		1.6	1.8	
31/05/19	1620-1634	25/Cloudy	Middle	11.0	24.5	31.3 31.4	31.4	7.56	7.55		108.3 108.2	108.3	3.70 3.74	3.72	3.76	2.3 1.9	2.1	1.9
			Bottom	20.9	24.3	31.6	31.6	7.41	7.40	7.40	106.0	105.8	3.92	3.94		1.9	1.9	1
			Dottom	20.0	_1.0	31.5	51.0	7.38			105.6		3.95	0.01		1.9		

# Mid-Flood Tide

#### Monitoring Station : TKO-M4a

Date	Sampling	Ambient Temp (°C) / Weather	Monitorir	ng Depth	Temp	Salinit	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Date	Duration	Condition	(n	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.1	29.5 29.5	29.5	7.14 7.17	7.16		102.1 102.4	102.3	3.60 3.63	3.62		3.3 3.6	3.5	
02/05/19	1646-1702	22/Fine	Middle	10.3	24.9	29.6 29.7	29.7	7.25 7.23	7.24	7.20	103.2 103.0	103.1	3.77 3.75	3.76	3.75	4.0 4.1	4.1	4.7
			Bottom	19.5	24.7	29.9 29.9	29.9	7.30	7.32	7.32	103.8 104.1	104.0	3.90	3.88		6.5 6.8	6.7	
			Surface	1.0	25.8	32.0 32.1	32.1	7.02	7.00		104.1 103.2 102.7	103.0	3.49 3.45	3.47		2.9 3.4	3.2	
04/05/19	1542-1555	25/Cloudy	Middle	10.2	25.5	32.3	32.3	6.88	6.86	6.93	100.8	100.6	3.78	3.77	3.70	2.7	2.5	2.6
			Bottom	19.4	25.4	32.3 32.3	32.4	6.84 6.81	6.83	6.83	100.3 99.7	99.9	3.75 3.89	3.87		2.3 2.3	2.2	
			Surface	1.0	21.7	32.4 31.8	31.8	6.84 7.25	7.27		100.1 99.2	99.5	3.85	3.41		2.1 2.4	2.4	
06/05/19	0907-0922	23/Cloudy	Middle	10.0	21.6	31.7 31.9	32.0	7.29 7.16	7.15	7.21	99.7 97.8	97.7	3.42 3.61	3.59	3.58	2.3 2.7	2.8	2.5
			Bottom	18.9	21.4	32.0 32.1	32.1	7.13 6.99	6.98	6.98	97.5 95.4	95.3	3.57 3.72	3.74		2.9 2.3	2.4	-
			Surface	1.0	19.7	32.1 31.4	31.4	6.97 7.36	7.35		95.1 96.8	96.7	3.75 3.51	3.53		2.5 3.2	3.1	
08/05/19	0908-0923	21/Cloudy	Middle	9.9	19.6	31.4 31.5	31.5	7.34 7.17	7.16	7.25	96.6 94.2	94.0	3.54 3.65	3.63	3.65	2.9 2.7	2.6	2.8
			Bottom	18.7	19.4	31.5 31.7	31.7	7.14 7.01	7.03	7.03	93.8 91.9	92.2	3.61 3.80	3.79		2.5 2.8	2.7	-
			Surface	1.0	21.7	31.6 31.1	31.2	7.05 7.55	7.48		92.4 103.0	102.0	3.78 3.34	3.36		2.5 3.2	3.4	
10/05/19	0855-0913	28/Fine	Middle	10.0	21.5	31.2 31.4	31.4	7.40 7.22	7.28	7.38	100.9 98.2	99.0	3.38 3.27	3.29	3.28	3.5 4.5	4.6	4.3
			Bottom	18.9	21.3	31.4 31.6	31.7	7.34 7.43	7.37	7.37	99.8 100.9	100.1	3.31 3.16	3.18		4.7 4.9	4.9	
			Surface	1.0	25.5	31.7 31.4	31.5	7.31 7.51	7.48		99.3 109.6	109.2	3.19 3.07	3.04		4.9 4.7	4.6	
14/05/19	1405-1422	29/Cloudy	Middle	9.9	25.4	31.5 31.7	31.7	7.45 7.19	7.23	7.35	108.8 104.8	105.3	3.01 2.95	2.93	3.07	4.5 4.3	4.7	4.8
			Bottom	18.8	25.2	31.7 31.8	31.9	7.26	7.05	7.05	105.8 102.3	102.6	2.91 3.23	3.25		5.0 5.2	5.1	
			Surface	1.0	25.7	31.9 31.7 31.7	31.7	7.07 7.26 7.20	7.23		102.9 106.4 105.6	106.0	3.27 3.28 3.25	3.27		5.0 2.5	2.4	
16/05/19	1621-1639	31/Cloudy	Middle	9.9	25.5	31.9	31.9	7.11	7.09	7.16	103.9	103.5	3.13	3.11	3.24	2.3 2.5	2.4	2.3
			Bottom	18.7	25.4	31.9 32.0 31.9	32.0	7.06 6.93 6.90	6.92	6.92	103.1 101.0 100.6	100.8	3.09 3.35 3.31	3.33		2.3 2.4 2.0	2.2	

# Mid-Flood Tide

#### Monitoring Station : TKO-M4a

Date	Sampling	Ambient Temp (°C) / Weather	Monitorir	ng Depth	Temp	Salinit	ty (ppt)	Dissolv	ved Oxyger	ı (mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Date	Duration	Condition	(n	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.8	32.1 32.0	32.1	7.17 7.14	7.16		105.6 105.2	105.4	3.58 3.55	3.57		1.7	1.8	
18/05/19	1634-1647	30/Cloudy	Middle	9.9	25.7	32.2	32.2	6.98	6.97	7.06	102.6	102.4	3.81	3.83	3.75	1.9 2.3	2.2	1.8
10/00/10	1001 1011	ee, eleday	inidato	0.0	20.1	32.2 32.2		6.95 6.90	0.01		102.2 101.3	102.1	3.84 3.89	0.00		2.0		-
			Bottom	18.8	25.6	32.2	32.2	6.88	6.89	6.89	101.3	101.1	3.85	3.87		1.4 1.4	1.4	
			Surface	1.0	27.8	31.7	31.7	7.33	7.32		111.4	111.1	3.47	3.45		3.6	3.4	
00/05/10		0.1/5/				31.6 31.8		7.30 7.21		7.27	110.8 109.2		3.43 3.61			3.2 2.7		
20/05/19	0907-0921	31/Fine	Middle	9.8	27.6	31.8	31.8	7.23	7.22		109.6	109.4	3.59	3.60	3.61	2.9	2.8	2.9
			Bottom	18.6	27.5	32.0 31.9	32.0	7.11 7.09	7.10	7.10	107.7 107.0	107.4	3.79 3.76	3.78		2.6 2.3	2.5	
			Surface	1.0	22.7	31.6	31.6	7.66	7.65		107.0	106.4	3.40	3.42		1.6	1.6	
			Surface	1.0	22.1	31.5	51.0	7.64	7.05	7.59	106.3	100.4	3.44	3.42		1.5	1.0	-
22/05/19	0906-0920	24/Cloudy	Middle	10.0	22.5	31.7 31.7	31.7	7.55 7.51	7.53		104.7 104.2	104.5	3.58 3.55	3.57	3.55	2.2 1.9	2.1	1.9
			Bottom	18.9	22.3	31.9	31.9	7.32	7.34	7.34	101.2	101.5	3.66	3.65		2.3	2.2	1
						31.8 31.4		7.35 7.69			101.7 111.9		3.64 3.61			2.0 2.1		
			Surface	1.0	25.4	31.4	31.4	7.77	7.73	7.65	113.1	112.5	3.64	3.63		1.8	2.0	
24/05/19	0907-0921	26/Cloudy	Middle	9.9	25.1	31.7	31.7	7.64	7.58	7.05	110.8	109.9	3.45	3.47	3.47	1.9	1.8	1.7
				10.0		31.7 31.9		7.51 7.36	- 10	= 10	109.0 106.8		3.49 3.32			1.7 1.2		•
			Bottom	18.8	25.0	31.9	31.9	7.48	7.42	7.42	108.5	107.7	3.33	3.33		1.4	1.3	
			Surface	1.0	25.6	31.0 31.0	31.0	7.88 7.95	7.92		114.8 115.8	115.3	3.60	3.62		1.8 1.9	1.9	
27/05/19	1327-1344	27/Cloudy	Middle	9.9	25.3	31.0	31.1	7.63	7.70	7.81	110.7	111.7	3.48	3.45	3.43	2.3	2.3	2.9
21/03/13	1327-1344	21/0/000	Wilduic	5.5	20.0	31.1 31.2	01.1	7.77 7.44	1.10		112.7 107.9		3.41 3.20	0.40	0.40	2.2	2.0	- 2.5
			Bottom	18.8	25.2	31.2	31.2	7.44	7.51	7.51	107.9	108.9	3.20	3.23		4.5 4.7	4.6	
			Surface	1.0	25.4	31.1	31.1	7.82	7.88		113.6	114.5	3.72	3.75		1.7	1.6	
						31.1 31.4		7.93 7.74		7.84	115.3 112.3		3.77 3.59			1.5 2.0		
29/05/19	1407-1424	26/Cloudy	Middle	9.9	25.2	31.4	31.4	7.86	7.80		114.1	113.2	3.64	3.62	3.55	1.7	1.9	1.9
			Bottom	18.8	25.0	31.5 31.6	31.6	7.57 7.43	7.50	7.50	109.7 107.6	108.7	3.31 3.28	3.30		2.1 2.3	2.2	
			Surface	1.0	24.8	31.3	31.3	7.66	7.65		1107.0	110.2	3.69	3.68		1.7	1.7	<u> </u>
			Suilace	1.0	24.0	31.2	31.3	7.63	CO. 1	7.55	109.9	110.2	3.67	3.00	ļ	1.7	1./	-
31/05/19	1638-1654	25/Cloudy	Middle	9.8	24.6	31.4 31.4	31.4	7.43	7.45		106.8 107.3	107.1	3.83 3.79	3.81	3.82	1.9 2.1	2.0	1.9
			Bottom	18.6	24.5	31.6	31.6	7.30	7.31	7.31	104.9	105.1	3.97	3.96		1.8	1.9	1
			Bottom			31.6	00	7.32			105.2		3.94	0.00		1.9		

# Mid-Flood Tide

#### Monitoring Station : TKO-M5

Date	Sampling	Ambient Temp (°C) / Weather	Monitorir	0 1	Temp	Salinit	ty (ppt)	Dissolv	ved Oxygen	ı (mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	Ū)	Susper	nded Solids	s (mg/L)
Date	Duration	Condition	(n	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	24.9	29.5 29.6	29.6	7.04	7.06		100.6 100.9	100.8	3.54 3.56	3.55		3.7 3.2	3.5	
02/05/19	1709-1719	22/Fine	Middle	9.3	24.7	29.7 29.8	29.8	7.00	6.99	7.02	99.7 99.4	99.6	3.68	3.70	3.63	2.6	2.4	3.0
			Bottom	17.6	24.8	29.9	- 30.0	6.85	6.87	6.87	97.4	97.6	3.64	3.66		2.2 3.1	3.0	
				1.0	05.7	30.0 32.1	20.4	6.88 7.14	7.40		97.7 105.0	105.2	3.67 3.29	2.24		2.9 1.6	1.6	
			Surface	1.0	25.7	32.0 32.1	32.1	7.17 7.02	7.16	7.10	105.4 102.6	105.2	3.33 3.54	3.31		1.6 2.1	1.0	-
04/05/19	1559-1612	25/Cloudy	Middle	9.2	25.4	32.2	32.2	7.05	7.04		103.0	102.8	3.49	3.52	3.50	1.8	2.0	1.7
			Bottom	17.4	25.3	32.3 32.2	32.3	6.87 6.84	6.86	6.86	100.4 100.0	100.2	3.70 3.66	3.68		1.5 1.5	1.5	
			Surface	1.0	21.7	31.7 31.7	31.7	7.21 7.18	7.20		98.6 98.2	98.4	3.16 3.18	3.17		2.2 1.9	2.1	
06/05/19	0928-0942	23/Cloudy	Middle	9.0	21.5	31.8 31.9	31.9	7.06 7.02	7.04	7.12	96.3 95.8	96.1	3.34 3.32	3.33	3.32	2.0 2.1	2.1	2.0
			Bottom	16.9	21.3	32.0	32.0	6.86	6.88	6.88	93.3	93.5	3.45	3.47		1.8	1.8	
			Surface	1.0	19.7	32.0 31.3	31.3	6.89 7.55	7.53		93.7 99.3	99.0	3.48 3.08	3.06		1.7 2.8	2.7	
					-	31.2 31.4		7.51 7.31		7.43	98.7 95.8		3.04 3.21			2.5 2.1		
08/05/19	0928-0941	21/Cloudy	Middle	9.1	19.5	31.4	31.4	7.33	7.32		96.1	96.0	3.19	3.20	3.21	2.1	2.1	2.2
			Bottom	17.1	19.3	31.6 31.5	31.6	7.16 7.13	7.15	7.15	93.7 93.2	93.5	3.36 3.39	3.38		1.9 1.8	1.9	
			Surface	1.0	21.7	31.1 31.2	31.2	7.51 7.46	7.49		102.4 101.7	102.1	3.41 3.43	3.42		4.3 4.3	4.3	
10/05/19	0919-0936	28/Fine	Middle	8.9	21.5	31.4 31.5	31.5	7.35 7.44	7.40	7.44	100.0 101.2	100.6	3.36 3.33	3.35	3.28	3.0 2.8	2.9	3.4
			Bottom	16.8	21.3	31.7 31.7	31.7	7.26	7.33	7.33	98.6 100.4	99.5	3.04 3.08	3.06		2.8 3.1	3.0	-
			Surface	1.0	25.5	31.4	31.5	7.55	7.57		110.2	110.5	3.00	2.98		4.4	4.6	
14/05/19	1426-1448	29/Cloudy	Middle	8.9	25.3	31.5 31.7	31.7	7.59 7.34	7.32	7.45	110.8 106.9	106.7	2.95 2.84	2.86	2.99	4.8 3.8	4.0	4.7
			Bottom	16.7	25.1	31.6 31.9	31.9	7.30 7.15	7.13	7.13	106.4 103.8	103.5	2.88 3.16	3.15		4.2 5.5	5.5	-
						31.9 31.6		7.10 7.32		1.13	103.1 107.3		3.13 3.15			5.5 2.8		
			Surface	1.0	25.7	31.7	31.7	7.36	7.34	7.24	107.9	107.6	3.12	3.14		3.0	2.9	-
16/05/19	1642-1700	31/Cloudy	Middle	9.0	25.5	31.9 31.8	31.9	7.18 7.11	7.15		104.9 103.8	104.4	3.04 3.00	3.02	3.14	2.2 2.4	2.3	2.7
			Bottom	16.9	25.3	32.0 32.0	32.0	7.00 6.95	6.98	6.98	101.9 101.2	101.6	3.27 3.23	3.25		2.9 2.7	2.8	

# Mid-Flood Tide

#### Monitoring Station : TKO-M5

Date Sampling Duration Ambient Temp (°C) / Weather Condition		Monitorin	0 1	Temp	Salini	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	Suspended Solids (mg/L)				
	(m	ר)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average				
18/05/19 1651-1704			Surface	1.0	25.8	32.1	32.1	7.24	7.22	410.440	106.6	106.3	3.66	3.65	urorado	1.5	1.6			
						32.1		7.20	7.14	106.0		3.63			1.6					
	30/Cloudy	Middle	9.2	25.7	32.2 32.2	32.2	7.07	7.06		103.9 103.5	103.7	3.77 3.73	3.75	3.76	1.0	1.0	1.2			
						32.2		6.85			103.5		3.90			1.0 1.1		-		
			Bottom	17.4	25.8	32.1	32.1	6.88	6.87	6.87	100.9	100.7	3.86	3.88		1.1	1.2			
			Quinfana	1.0	27.9	31.7	24.0	7.20	7.22		109.6	109.9	3.52	0.54		2.4	2.3			
			Surface	1.0	27.9	31.8	31.8	7.24	1.22	7.15	110.2	109.9	3.50	3.51		2.2	2.3			
20/05/19	0925-0938	31/Fine	Middle	9.1	27.7	31.9	31.9	7.09	7.08	7.15	107.6	107.4	3.66	3.64	3.66	2.1	2.3	2.1		
20/03/13	0323-0330	01/11/10	Wildale	0.1	21.1	31.9	01.0	7.06	1.00		107.1	107.4	3.62	0.04	0.00	2.4	2.0	2.1		
			Bottom	17.2	27.5	32.0	32.0	6.94	6.93	6.93	105.2	105.1	3.81	3.83		1.8	1.9			
					32.0		6.92			104.9		3.84			1.9	-				
		24/Cloudy			Surface	1.0	22.8	31.4	31.4	7.51	7.50		104.6	104.3	3.36	3.34		1.2	1.3	
						31.3 31.5		7.48 7.40		7.44	104.0 102.9		3.32 3.51		+	1.3				
22/05/19 0925-0938	0925-0938		Middle	9.3	22.7	31.5	31.6	7.40	7.38		102.9	102.7	3.51	3.52	3.52	2.3 2.0	2.2	1.6		
						31.7		7.21			102.4		3.72		1	1.5		-		
		Bottom	17.5	22.5	31.7	31.7	7.23	7.22	7.22	100.3	100.2	3.69	3.71		1.5	1.5				
			Quarteres	1.0	05.4	31.4	24.4	7.94	7.04		115.5	445.4	3.55	0.57		1.7	4.0			
			Surface	1.0	25.4	31.4	31.4	7.88	7.91	7.85	114.7	115.1	3.58	3.57		1.5	1.6			
24/05/19	0928-0940	26/Cloudy	Middle	9.1	25.1	31.7	31.7	7.86	7.79	7.00	114.0	113.0	3.34	3.32	3.39	1.2	1.3	1.3		
24/00/10	0020 0010	20,0.0003	inidalo	0.1	20.1	31.7	01.7	7.71	1.10		111.9	110.0	3.30	0.02	0.00	1.3	1.0	1.0		
			Bottom	n 17.1	25.0	31.8	31.9	7.82	7.88	7.88	113.5	114.3	3.25	3.27		1.2	1.2			
						31.9		7.93			115.0		3.29			1.1		2.4		
		27/Cloudy	Surface	face 1.0	25.6 25.3	31.0 31.0	31.0	7.70 7.78	7.74		112.2 113.4	112.8 110.6	3.62 3.64	3.63		2.6 2.4	2.5			
						31.0		7.65		7.68	111.0		3.28		3.37	3.2				
27/05/19	1352-1411		Middle	ddle 9.0		31.1	31.1	7.59	7.62		110.1		3.29	3.29		2.9	3.1			
						31.2	1	7.30			105.9		3.17			1.8				
			Bottom	16.9	25.2	31.3	31.3	7.43	7.37	7.37	107.8	106.9	3.21	3.19		1.5	1.7			
			Surface	1.0	25.4	31.1	31.2	7.58	7.52		110.2	109.3	3.50	3.51		3.0	2.8			
			Sunace	1.0	20.4	31.2	51.2	7.46	1.52	7.44	108.4	103.5	3.51	3.51		2.6	2.0			
29/05/19	1432-1449	26/Cloudy	Middle	9.2	25.2	31.3	31.4	7.33	7.36	1.77	106.4	106.8	3.34	3.33	3.34	1.6	1.7	2.1		
						31.4		7.39			107.2	100.0	3.31		0.04	1.7		2.1		
			Bottom	17.3	25.0	31.6	31.6	7.40	7.48	7.48	107.2	108.4	3.16	3.19		2.0	2.0			
						31.6 31.1		7.56 7.57			109.5 108.6		3.21 3.50			1.9		1.5		
			Surface	e 1.0	24.6	31.1	31.2	7.57	7.58		108.6	108.8	3.50	3.52		1.6 1.4	1.5			
			Middle			31.2		7.33		7.46	105.0		3.75		3.71	1.4				
31/05/19	1700-1715	25/Cloudy		9.3	24.4	31.3	31.4	7.36	7.35		105.3	105.2	3.77	3.76		1.5	1.6			
			Detter	47.5	04.0	31.5	24.5	7.28	7.00	7.00	104.0	400.7	3.86	0.04		1.2	4.0			
			Bottom	17.5	24.2	31.5	31.5	7.24	7.26	7.26	103.4	103.7	3.82	3.84		1.3	1.3			

### Mid-Ebb Tide



#### Monitoring Station : TKO-C1a

Date Sampling		Ambient Temp (°C) / Weather	Monitorin	ng Depth	Temp	Salinit	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	nded Solids	; (mg/L)			
Dale	Duration	Condition	n)	n)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average			
02/05/19 1049-1107						Surface	1.0	25.0	29.5 29.4	29.5	7.10 7.04	7.07	0.00	101.5 100.9	101.2	3.47 3.51	3.49		4.7 4.9	4.8	
	1049-1107	22/Fine	Middle	11.0	24.7	29.7 29.7	29.7	6.91 6.88	6.90	6.98	98.4 98.1	98.3	3.60 3.63	3.62	3.61	4.6 5.3	5.0	4.7			
			Bottom	20.9	24.7	29.9 30.0	30.0	7.13	7.15	7.15	101.4 101.7	101.6	3.71 3.74	3.73		4.1 4.5	4.3				
			Surface	1.0	25.3	31.9 31.9	31.9	7.09	7.07		103.3 102.8 103.1	3.55 3.51	3.53		2.7	2.6					
04/05/19	1027-1041	24/Cloudy	Middle	10.3	25.1	32.1 32.0	32.1	6.87 6.84	6.86	6.96	102.0 100.0 99.5	99.8	3.72 3.76	3.74	3.74	3.4 3.7	3.6	2.9			
		-	Bottom	19.6	25.1	32.0 32.2 32.3	32.3	6.80 6.84	6.82	6.82	99.5 98.9 99.4	99.2	3.96 3.92 3.94		3.7 2.7 2.3	2.5					
			Surface	1.0	20.8	31.7 31.7	31.7	7.17 7.20	7.19		96.5	96.7	3.43 3.41	3.42		2.4	2.4				
06/05/19	1335-1350	22/Cloudy	Middle	10.4	20.7	31.7 31.8 31.9	31.9	7.20 7.01 7.03	7.02	7.10	96.9 94.2 94.5	94.4	3.41 3.57 3.53	3.55	3.56	2.3 3.5	3.4	2.8			
			Bottom	19.8	20.5	32.0	32.0	6.88	6.86	6.86	92.2	92.0	3.73	3.72		3.3 2.8	2.6				
			Surface	1.0	20.8	32.0 31.3	31.3	6.84 7.28	7.30		91.7 97.7	98.0	3.70 3.44	3.43		2.4 3.9	4.0				
08/05/19	1353-1408	22/Cloudy	Middle	10.3	20.7	31.2 31.4	31.4	7.32 7.15	7.14	7.22	98.3 95.8	95.6	3.42 3.61	3.59	3.60	4.1 3.8	4.0	3.6			
			Bottom	19.6	20.6	31.4 31.5	31.5	7.12 6.98	7.00	7.00	95.4 93.4	93.6	3.57 3.75	3.77		4.1 2.9	3.0				
		29/Fine	Surface	1.0	21.8	31.5 31.1	31.1	7.01 7.44	7.51	7.40	93.8 101.6	102.5	3.78 3.69	3.70		3.0 4.2	4.4	4.4			
10/05/19	1542-1600		Middle	10.6	21.6	31.1 31.3	31.4	7.57 7.31	7.29		103.4 99.5	99.2	3.71 3.48	3.50	3.53	4.5 4.4	4.3				
			2011 110	20/1 110		Bottom	20.1	21.3	31.4 31.6	31.6	7.26 7.12	7.20	7.20	98.9 96.6	97.7	3.51 3.37	3.38		4.1 4.2	4.5	
			Surface	1.0	25.3	31.6 31.5	31.5	7.28 7.25	7.27		98.7 105.6	105.9	3.39 3.15	3.13		4.7 3.1	3.2				
14/05/19	0852-0909	27/Cloudy	Middle	10.6	25.2	31.4 31.7	31.7	7.29 7.07	7.04	7.15	106.2 102.9	102.5	3.11 3.02	3.00	3.13	3.2 4.2	4.3	4.4			
14/00/10	0002-0000	21/0/0003	Bottom	20.1	25.1	31.7 31.8	31.9	7.00 6.84	6.87	-	102.0 99.3	99.7	2.97 3.25	3.27	3.13	4.3 5.6	5.7	4.4			
			Surface	1.0	25.5	31.9 31.8	31.8	6.89 7.17	7.15	0.07	100.0 104.8	104.5	3.28 3.36	3.38		5.7 3.8	3.9				
16/05/19	0953-1012	29/Cloudy		10.6	25.5	31.8 31.9	32.0	7.13 6.94	6.97	7.06	104.2 101.0		3.40 3.23	3.22	3.38	4.0 3.1	3.9	3.3			
10/05/19	0900-1012	29/Ci0uuy	Middle			32.0 32.1		6.99 6.75			101.8 98.1	101.4	3.20 3.56			3.2 2.8	-				
		Bottom	20.2	25.1	32.0	32.1	6.71	6.73	6.73	97.5	97.8	3.51	3.54		2.6	2.7					

### Mid-Ebb Tide



#### Monitoring Station : TKO-C1a

Date Sampling		Ambient Temp (°C) / Weather	Monitorin	g Depth	Temp	Salinit	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	Suspended Solids (mg/L)						
Dale	Duration	Condition	(m	1)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average					
								Surface	1.0	25.7	31.9 31.8	31.9	7.08 7.06	7.07		103.9 103.6	103.8	3.60 3.66	3.63		1.9 1.9	1.9	
18/05/19	1112-1126	30/Cloudy	Middle	10.2	25.6	32.0 32.0	32.0	6.86 6.82	6.84	6.96 100.5 100.3 100.3	100.3	3.88 3.84	3.86	3.81	1.3	1.4	1.7						
			Bottom	19.4	25.5	32.1 32.2	32.2	6.80 6.77	6.79	6.79	99.5 99.1	99.3	3.95 3.91	3.93		1.5 1.8	1.7						
			Surface	1.0	28.9	31.6 31.7	31.7	7.25	7.24		112.1 111.8	112.0	3.50	3.48		4.1	4.0						
20/05/19	1331-1345	32/Fine	Middle	10.6	28.7	31.8 31.8	31.8	7.08	7.09	7.16	109.3 109.6	109.5	3.64 3.62	3.63 3.66	3.66	3.7	3.6	3.5					
			Bottom	20.2	28.6	31.9	32.0	6.92	6.94	6.94	106.6	106.9	3.88 3.87	3.87		3.4 2.9	3.1						
			Surface	1.0	25.7	32.0 31.5	31.5	6.96 7.45	7.44		107.2 109.1	108.9	3.85 3.39	3.41		3.2 3.7	3.9						
22/05/19	1353-1407	28/Fine	Middle	10.7	25.6	31.5 31.7	31.7	7.42	7.31	7.37	108.6 106.9	107.1	3.42 3.55	3.53	3.57	4.0 3.4	3.6	3.5					
			Bottom	20.4	25.4	31.6 31.8	31.8	7.32 7.14	7.16	7.16	107.2 104.2	104.5	3.51 3.75	3.76		3.8 2.8	2.9						
		27/Cloudy	Surface	1.0	25.5	31.8 31.4	31.4	7.18 7.67	7.73		104.8 111.9	112.8	3.77 3.74	3.76		3.0 3.0	3.0						
24/05/19	1522-1539		Middle	10.8	25.2	31.4 31.6	31.6	7.79 7.58	7.51	7.62	113.7 110.2	109.1	3.78 3.66	3.68	3.66	2.9 2.0	1.9	2.4					
			Bottom	20.6	25.0	31.6 31.7	31.8	7.43 7.55	7.60	7.60	107.9 109.4	110.1	3.69 3.53	3.54		1.8 2.3	2.5						
		26/Cloudy	Surface	1.0	25.4	31.8 31.0	31.0	7.64 7.49	7.54		110.7 108.8	109.5	3.54 3.81	3.84		2.6 3.8	3.8	4.3					
27/05/19	0906-0918		Middle	10.7	25.2	31.0 31.1	31.1	7.58 7.61	7.57	7.55	110.1 110.2	109.6	3.86 3.72	3.74	3.73	3.7 4.3	4.4						
21100/10	0300-0310	20/010003	Bottom	20.4	25.1	31.1 31.3	31.4	7.52 7.36	7.41	7.41	108.9 106.6	107.3	3.76 3.62	3.60	3.73	4.5 4.4	4.7						
			Surface	1.0	25.3	31.4 31.0	31.1	7.45 7.41	7.41	7.41	107.9 107.5	107.5	3.58 3.76	3.78		4.9 3.6	3.6						
20/05/40	0005 0000					31.1 31.3		7.55 7.34	-	7.45	109.6 106.3		3.80 3.65		2.00	3.5 3.7		25					
29/05/19	0925-0939	25/Cloudy	Middle	10.7	25.1	31.3 31.5	31.3	7.49 7.26	7.42		108.5 105.1	107.4	3.69 3.61	3.67	3.68	3.9 3.1	3.8	3.5					
			Bottom	20.4	25.0	31.6 31.2	31.6	7.14	7.20	7.20	103.3 113.6	104.2	3.54 3.70	3.58		2.9 2.3	3.0	1.9					
			Surface	1.0	26.8	31.1 31.3	31.2	7.60 7.45	7.61	7.54	113.1 110.7	113.4	3.74 3.86	3.72	3.85	2.0	2.2						
31/05/19	1004-1019	27/Cloudy	Middle	10.9	26.6	31.3 31.5	31.3	7.43	7.46		110.7 111.0 108.6	110.9	3.83 3.99	3.85		1.8	1.7						
		Bottom	20.7	26.4	31.5	31.5	7.33	7.32	7.32	108.6	108.4	3.99 3.97	3.98		1.8 2.0	1.9							

### Mid-Ebb Tide

#### Monitoring Station: TKO-M4a

Date Sampling Duration	Sampling	Ambient Temp	Monitoring Depth (m)		Temp			Dissol	ved Oxygen	(mg/L)	Dissolved Oxygen Saturation (%)		Turbidity (NTU)			Susper	spended Solids (mg/L)		
	(°C) / Weather Condition	Monitoring Depth (III)		(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average		
02/05/19 1112-1125			Surface	1.0	25.1	29.6 29.6	29.6	7.04 7.07	7.06		100.7 101.0	100.9	3.31 3.34	3.33	Ť	3.1 3.6	3.4		
	1112-1125	22/Fine	Middle	10.1	24.8	29.8 29.7	29.8	7.13 7.15	7.14	7.10	101.5 101.7	101.6	3.52 3.54	3.53	3.49	4.9 5.2	5.1	4.6	
			Bottom	19.1	24.6	30.0 30.1	30.1	7.28	7.29	7.29	103.5 103.7	103.6	3.60 3.63	3.62		5.2 5.2 5.2	5.3	-	
			Surface	1.0	25.4	31.9 32.0	32.0	7.11	7.13		103.7 103.8 104.2	104.0	3.43 3.40	3.42		5.2 1.9 2.0	2.0		
04/05/19	1044-1058	24/Cloudy	Middle	9.7	25.2	32.0 32.1 32.1	32.1	6.95 6.91	6.93	7.03	104.2 101.3 100.7	101.0	3.40 3.68 3.65	3.67	3.65	3.9	4.1	2.9	
			Bottom	18.4	25.1	32.3	32.3	6.86	6.85	6.85	99.8 99.4	99.6	3.85	3.87		4.3 2.6	2.6		
			Surface	1.0	20.7	32.3 31.8 31.8	31.8	6.83 7.11 7.15	7.13		99.4 95.6 96.1	95.9	3.89 3.55 3.51	3.53		2.5 2.5	2.7	2.6	
06/05/19	1354-1410	22/Cloudy	Middle	9.8	20.5	31.8 31.9 31.9	31.9	6.98 7.00	6.99	7.06	96.1 93.6 93.8	93.7	3.51 3.72 3.74	3.73	3.70	2.8 3.2 3.0	3.1		
			Bottom	18.6	20.4	32.0 32.1	32.1	6.85 6.82	6.84	6.84	93.8 91.7 91.3	91.5	3.83 3.86	3.85		2.1 2.0	2.1		
			Surface	1.0	20.7	31.3 31.3	31.3	7.22	7.21		96.8 96.4	96.6	3.63 3.66	3.65		3.2 3.0	3.1		
08/05/19	1412-1427	22/Cloudy	Middle	9.8	20.6	31.4 31.5	31.5	7.07	7.05	7.13	94.7 94.1	94.4	3.84 3.81	3.83	3.81	3.3 3.6	3.5	3.4	
			Bottom	18.5	20.5	31.6 31.6	31.6	6.90 6.88	6.89	6.89	92.3 92.0	92.2	3.99	3.97		3.6 3.4 3.8	3.6		
		29/Fine	Surface	ce 1.0	21.8	31.1 31.1	31.1	7.43	7.38		101.5 100.1	100.8	3.54 3.50	3.52		4.5 4.5	4.5	4.4	
10/05/19	1604-1622		Middle	9.8	21.6	31.3 31.4	31.4	7.20	7.18	7.28	98.1 97.4	97.8	3.39 3.42	3.41	3.40	4.5	4.7		
			Bottom	18.5	21.3	31.6 31.6	31.6	7.26	7.22	7.22	98.5 97.4	98.0	3.26 3.28	3.27		3.9 4.0	4.0		
			Surface	1.0	25.3	31.5 31.6	31.6	7.34	7.32		106.9 106.4	106.7	3.23 3.20	3.22		3.9 3.6	3.8		
14/05/19	0911-0930	27/Cloudy	Middle	9.8	25.1	31.7 31.8	31.8	7.15 7.12	7.14	7.23	103.5 103.1	103.3	3.12 3.08	3.10	3.21	4.7 4.2	4.5	4.3	
			Bottom	18.5	25.0	31.9 31.9	31.9	6.96 6.91	6.94	6.94	100.9 100.2	100.6	3.34 3.31	3.33		4.3	4.6		
			Surface	1.0	25.5	31.8 31.7	31.8	7.15 7.09	7.12		104.5 103.6	104.1	3.34 3.31	3.33		2.8	3.0		
16/05/19	1014-1030	29/Cloudy	Middle	9.7	25.3 31.9	31.9 31.9	31.9	6.87 6.80	6.84	6.98	100.0 99.2	99.6	3.17 3.15	3.16	3.31	2.8	2.7	3.0	
			Bottom	18.4	25.2	32.0 32.0	32.0	6.62 6.65	6.64	6.64	96.2 96.6	96.4	3.47	3.45		3.5 3.1	3.3		

### 東業德勤測試顧問有限公司 ETS-TESTCONSULT LIMITED

### Mid-Ebb Tide

#### Monitoring Station: TKO-M4a

Date	Sampling	Ambient Temp	Monitoring [	)ooth (m)	Temp	Salini	ty (ppt)	Dissol	ved Oxygen	(mg/L)		d Oxygen tion (%)	Τι	urbidity (NT	U)	Susper	nded Solids	s (mg/L)
Dale	Duration	(°C) / Weather Condition	wontoning L	Jeptin (III)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.7	31.9 31.9	31.9	7.05 7.01	7.03		103.5 103.0	103.3	3.57 3.54	3.56		1.5 1.6	1.6	
18/05/19	1128-1142	30/Cloudy	Middle	9.7	25.5	32.0 32.1	32.1	6.92 6.95	6.94	6.98	101.3 101.7	101.5	3.96 3.92	3.94	3.79	1.9	2.0	1.8
			Bottom	18.4	25.4	32.2 32.2	32.2	6.77 6.74	6.76	6.76	99.1 98.7	98.9	3.91 3.86	3.89		1.9 1.8	1.9	
			Surface	1.0	28.8	31.8 31.7	31.8	7.16	7.17		110.7 110.8	110.8	3.58 3.54	3.56		2.9	3.1	
20/05/19	1351-1406	32/Fine	Middle	9.7	28.6	31.9 31.9	31.9	7.04	7.03	7.10	108.5 108.0	108.3	3.71 3.68	3.70	3.72	2.7 2.3	2.5	3.1
			Bottom	18.4	28.4	32.1 32.0	32.1	6.89 6.85	6.87	6.87	106.0 105.2	105.6	3.90 3.92	3.91		3.5 3.8	3.7	
			Surface	1.0	25.8	31.6 31.6	31.6	7.56 7.52	7.54		111.0 110.4	110.7	3.63 3.60	3.62		2.4 2.8	2.6	
22/05/19	1411-1426	28/Fine	Middle	9.8	25.6	31.7 31.8	31.8	7.37 7.39	7.38	7.46	107.9 108.2	108.1	3.72 3.70	3.71	3.74	2.9 3.3	3.1	3.5
			Bottom	18.6	25.5	31.9 31.9	31.9	7.22 7.25	7.24	7.24	105.7 106.2	106.0	3.90 3.88	3.89		4.6 5.0	4.8	
			Surface	1.0	25.5	31.4 31.4	31.4	7.53 7.68	7.61	7.54	109.9 112.1	111.0	3.76 3.81	3.79		1.8 2.1	2.0	
24/05/19	1543-1558	27/Cloudy	Middle	9.8	25.2	31.5 31.6	31.6	7.42 7.52	7.47	7.54	107.8 109.3	108.6	3.59 3.64	3.62	3.63	2.0 1.7	1.9	1.8
			Bottom	18.5	25.0	31.8 31.8	31.8	7.59 7.66	7.63	7.63	110.0 111.0	110.5	3.48 3.51	3.50		1.5 1.8	1.7	
			Surface	1.0	25.4	31.0 31.1	31.1	7.64 7.51	7.58	7.49	110.0 109.1	109.6	3.78 3.80	3.79		3.4 3.5	3.5	
27/05/19	0922-0936	26/Cloudy	Middle	9.7	25.2	31.1 31.1	31.1	7.46 7.36	7.41	7.55	108.1 106.6	107.4	3.54 3.55	3.55	3.57	5.3 5.1	5.2	4.7
			Bottom	18.3	25.1	31.3 31.4	31.4	7.22 7.35	7.29	7.29	104.6 106.5	105.6	3.34 3.39	3.37		5.7 5.1	5.4	
			Surface	1.0	25.3	31.1 31.1	31.1	7.68 7.52	7.60	7.55	111.4 109.1	110.3	3.82 3.85	3.84		3.8 3.5	3.7	
29/05/19	0944-0955	25/Cloudy	Middle	9.8	25.1	31.0 31.4	31.2	7.44 7.56	7.50	1.00	107.8 109.5	108.7	3.71 3.74	3.73	3.74	3.2 3.6	3.4	3.8
			Bottom	18.5	25.0	31.5 31.5	31.5	7.31 7.40	7.36	7.36	105.7 107.0	106.4	3.64 3.67	3.66		4.2 4.5	4.4	
			Surface	1.0	26.7	31.2 31.2	31.2	7.54 7.52	7.53	7.46	112.2 111.9	112.1	3.76 3.72	3.74		2.0 2.3	2.2	
31/05/19	1024-1039	27/Cloudy	Middle	9.7	26.5	31.3 31.3	31.3	7.37 7.39	7.38		109.4 109.6	109.5	3.92 3.89	3.91	3.89	1.8 2.0	1.9	2.4
			Bottom	18.4	26.4	31.4 31.5	31.5	7.14 7.18	7.16	7.16	105.8 106.4	106.1	4.02 4.00	4.01		3.4 3.1	3.3	

### 東業德勤測試顧問有限公司 ETS-TESTCONSULT LIMITED

### Mid-Ebb Tide

### Monitoring Station : TKO-M5

Date	Sampling	Ambient Temp (°C) / Weather	Monitoring [	Depth (m)	Temp	Salini	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Т	urbidity (NT	U)	Susper	nded Solids	; (mg/L)
Dale	Duration	Condition	wormoring t	Septin (iii)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.0	29.5 29.6	29.6	6.94 6.90	6.92		99.2 98.8	99.0	3.40 3.43	3.42		3.8 3.5	3.7	
02/05/19	1131-1149	22/Fine	Middle	9.2	24.7	29.8 29.8	29.8	6.88 6.84	6.86	6.89	97.9 97.5	97.7	3.60 3.63	3.62	3.61	4.1 4.3	4.2	4.5
			Bottom	17.3	24.4	30.1 30.1	30.1	7.24 7.27	7.26	7.26	102.9 103.2	103.1	3.77 3.80	3.79		4.3 5.8 5.4	5.6	
			Surface	1.0	25.4	32.0 32.0	32.0	7.20	7.18		105.2 105.2 104.7	105.0	3.57 3.50	3.54		2.7 2.4	2.6	
04/05/19	1102-1115	24/Cloudy	Middle	8.8	25.2	32.0 32.1 32.2	32.2	6.91 6.94	6.93	7.05	104.7 100.7 101.2	101.0	3.71 3.75	3.73	3.68	1.4	1.3	1.8
			Bottom	16.6	25.1	32.3	32.4	6.85	6.87	6.87	99.7	99.9	3.79	3.78		1.2 1.5	1.5	
			Surface	1.0	20.7	32.4 31.8	31.8	6.88 7.06	7.05		100.1 94.9	94.7	3.76 3.33	3.34		1.4 2.4	2.6	
06/05/19	1415-1429	22/Cloudy	Middle	8.9	20.6	31.7 32.0	32.0	7.04 6.94	6.96	7.00	94.5 97.2	95.4	3.35 3.54	3.56	3.52	2.7 2.0	2.0	2.1
			Bottom	16.7	20.5	31.9 32.1	32.1	6.97 6.79	6.77	6.77	93.6 91.1	90.9	3.58 3.66	3.65		1.9 1.8	1.9	
			Surface	1.0	20.8	32.1 31.2	31.2	6.75 7.36	7.35	-	90.6 98.8	98.7	3.64 3.23	3.24		1.9 3.1	3.0	
08/05/19	1433-1447	22/Cloudy	Middle	9.0	20.6	31.2 31.3	31.4	7.34 7.18	7.16	7.26	98.5 96.0	95.8	3.25 3.40	3.38	3.39	2.8 1.9	1.8	2.2
			Bottom	16.9	20.5	31.4 31.5	31.5	7.14 7.06	7.07	7.07	95.6 94.4	94.6	3.36 3.57	3.56		1.6 2.0	2.0	
			Surface	1.0	21.8	31.5 31.1	31.2	7.08 7.30	7.26	1.01	94.8 99.7	99.1	3.54 3.45	3.47		2.0 3.7	3.6	
10/05/19	1630-1646	29/Fine	Middle	8.8	21.6	31.2 31.4	31.4	7.21 7.09	7.14	7.20	98.5 96.5	97.2	3.48 3.31	3.33	3.30	3.5 3.0	2.9	3.2
10/03/19	1030-1040	29/11110				31.4 31.5		7.18 7.01		7.00	97.8 95.1		3.34 3.10		5.50	2.7 3.4		
			Bottom	16.6	21.4	31.6 31.6	31.6	7.10 7.43	7.06	7.06	96.3 108.3	95.7	3.14 3.05	3.12		3.1 3.8	3.3	
			Surface	1.0	25.3	31.5 31.8	31.6	7.47 7.23	7.45	7.36	108.8 105.2	108.6	3.08 2.96	3.07		4.3 5.1	4.1	
14/05/19	0933-0945	27/Cloudy	Middle	8.7	25.2	31.8 31.9	31.8	7.29	7.26		106.1	105.7	2.92 3.16	2.94	3.05	4.8	5.0	4.5
			Bottom	16.4	25.0	32.0	32.0	7.00	7.03	7.03	101.4	101.8	3.13	3.15		4.4	4.6	
			Surface	1.0	25.5	31.8 31.8	31.8	7.23	7.26	7.15	105.6 106.5	106.1	3.10 3.05	3.08		2.5 2.8	2.7	
16/05/19	1036-1053	29/Cloudy	Middle	8.8	25.4	31.9 32.0	32.0	7.06 7.02	7.04		102.9 102.4	102.7	3.23 3.27	3.25	3.11	2.3 1.9	2.1	2.3
			Bottom	16.6	25.2	32.1 32.1	32.1	6.87 6.82	6.85	6.85	98.8 99.1	99.0	3.01 2.98	3.00		2.0 2.3	2.2	

### 東業德勤測試顧問有限公司 ETS-TESTCONSULT LIMITED

### Mid-Ebb Tide

### Monitoring Station : TKO-M5


Date	Sampling	Ambient Temp (°C) / Weather	Monitoring [	)enth (m)	Temp	Salinit	ty (ppt)	Dissolv	ved Oxygen	(mg/L)		d Oxygen tion (%)	Т	urbidity (NT	U)	Susper	nded Solids	s (mg/L)
Date	Duration	Condition	wormoring t	Jeptin (III)	(°C)	Value	Average	Value	Average	Depth- average	Value	Average	Value	Average	Depth- average	Value	Average	Depth- average
			Surface	1.0	25.7	32.0	32.0	7.11	7.10		104.4	104.2	3.66	3.65		1.5	1.5	
						31.9		7.08		6.99	104.0		3.64			1.4		-
18/05/19	1147-1200	30/Cloudy	Middle	8.8	25.5	32.1 32.1	32.1	6.89 6.87	6.88		100.8 100.5	100.7	3.71 3.75	3.73	3.74	1.3 1.3	1.3	1.2
						32.2		6.85			100.3		3.83			1.0		
			Bottom	16.6	25.5	32.1	32.2	6.81	6.83	6.83	99.9	100.2	3.86	3.85		0.9	1.0	
			Surface	1.0	28.8	31.8	31.8	7.03	7.05		108.7	108.9	3.63	3.62		2.3	2.2	
			Cunaco		20.0	31.8	01.0	7.06		6.99	109.1	10010	3.61	0.02		2.0		-
20/05/19	1411-1427	32/Fine	Middle	9.0	28.7	32.0 31.9	32.0	6.91 6.95	6.93		106.6 107.3	107.0	3.77 3.79	3.78	3.78	1.6	1.5	1.8
						31.9		6.86			107.3		3.79			1.4 1.7		
			Bottom	16.9	28.6	32.1	32.1	6.84	6.85	6.85	105.6	105.8	3.97	3.95		1.7	1.8	
			Surface	1.0	25.9	31.4	31.4	7.35	7.37		107.9	108.2	3.58	3.57		3.0	3.1	
			Surface	1.0	25.9	31.4	31.4	7.38	1.31	7.27	108.4	108.2	3.56	3.57		3.1	3.1	
22/05/19	1432-1447	28/Fine	Middle	9.1	25.7	31.6	31.6	7.20	7.18	1.21	105.6	105.3	3.69	3.67	3.69	3.2	3.1	3.0
				-		31.6		7.16			105.0		3.65			2.9		
			Bottom	17.2	25.6	31.8 31.7	31.8	7.07 7.09	7.08	7.08	103.5 103.8	103.7	3.81 3.84	3.83		3.0 2.8	2.9	
						31.7		7.09			112.7		3.63			2.0		
			Surface	1.0	25.5	31.5	31.5	7.81	7.77	7 70	114.0	113.4	3.66	3.65		1.8	1.9	
24/05/19	1605-1618	27/Cloudy	Middle	8.9	25.2	31.6	31.6	7.66	7.68	7.72	111.3	111.6	3.56	3.57	3.53	1.4	1.3	1.4
24/00/10	1000-1010	21/0/000	Wilduic	0.0	20.2	31.6	01.0	7.70	7.00		111.9	111.0	3.58	0.01	0.00	1.2	1.0	1.4
			Bottom	16.8	25.0	31.7	31.8	7.75	7.69	7.69	112.3	111.4	3.35	3.37		0.8	0.9	
						31.8 31.0		7.62 7.52			110.4 109.3		3.39 3.66			1.0 4.0		
			Surface	1.0	25.4	31.0	31.0	7.68	7.60		111.6	110.5	3.69	3.68		4.0	4.1	
07/05/40	0040.0057	20/01	Middle	0.0	25.2	31.1	24.4	7.61	7.00	7.64	110.2	444.0	3.40	2.42	3.47	4.5		4.0
27/05/19	0942-0957	26/Cloudy	Middle	8.8	25.2	31.1	31.1	7.75	7.68		112.3	111.3	3.44	3.42	3.47	4.2	4.4	4.0
			Bottom	16.6	25.1	31.4	31.4	7.47	7.51	7.51	108.2	108.8	3.29	3.32		3.8	3.7	
						31.4		7.55			109.4		3.35			3.5		
			Surface	1.0	25.3	31.1 31.1	31.1	7.39	7.43		107.2 108.4	107.8	3.70 3.77	3.74		3.8 3.4	3.6	
						31.3		7.51		7.49	108.8		3.65			4.7	 	
29/05/19	1001-1010	25/Cloudy	Middle	9.0	25.1	31.4	31.4	7.59	7.55		110.0	109.4	3.69	3.67	3.62	5.0	4.9	4.1
			Bottom	16.9	25.0	31.5	31.6	7.46	7.39	7.39	107.9	106.9	3.43	3.46		4.0	3.8	
			Bollom	10.9	25.0	31.6	51.0	7.32	7.39	7.59	105.9	100.9	3.48	3.40		3.6	3.0	
			Surface	1.0	26.9	31.2	31.3	7.49	7.48		111.8	111.6	3.65	3.66		1.7	1.7	
						31.3		7.46		7.37	111.3		3.67			1.6		-
31/05/19	1043-1100	27/Cloudy	Middle	9.1	26.7	31.4 31.4	31.4	7.25 7.28	7.27		107.9 108.3	108.1	3.81 3.85	3.83	3.80	1.7 1.3	1.5	1.5
						31.4		7.10			105.7		3.93			1.3		1
			Bottom	17.2	26.6	31.6	31.6	7.06	7.08	7.08	105.1	105.4	3.90	3.92		1.5	1.5	




Appendix D5

Graphical Plots of Impact Marine Water Quality Monitoring Data (3RS Project)



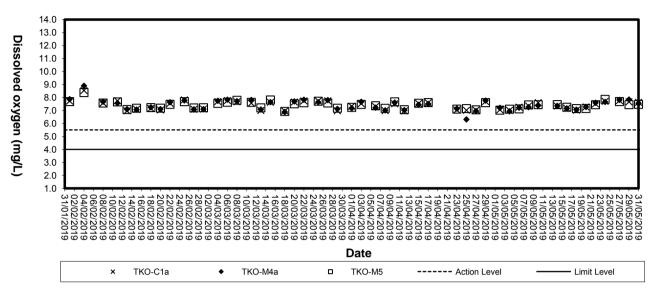


### Dissolved Oxygen (Surface & Middle) at Mid-Flood Tide (3RS project)

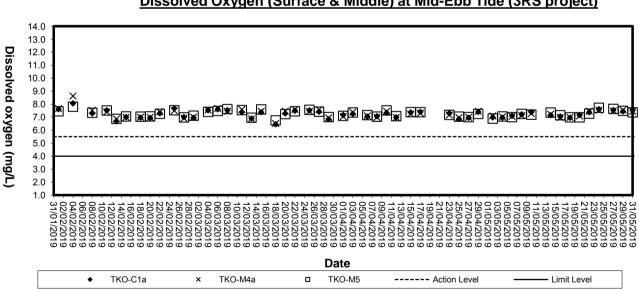


### Dissolved Oxygen (Surface & Middle) at Mid-Ebb Tide (3RS project)



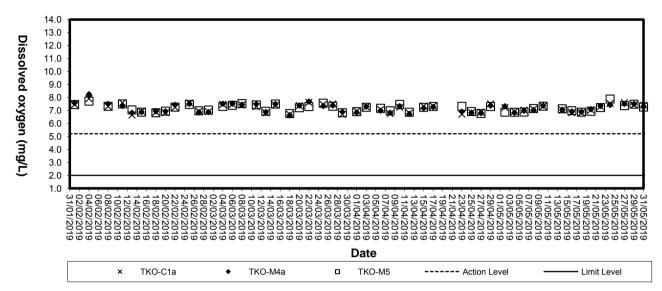


### Dissolved Oxygen (Bottom) at Mid-Flood Tide (3RS project)


### Dissolved Oxygen (Bottom) at Mid-Ebb Tide (3RS project)

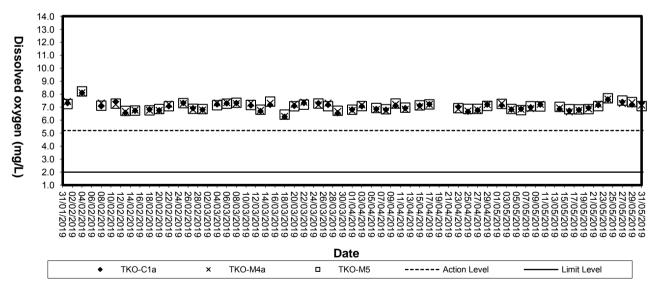



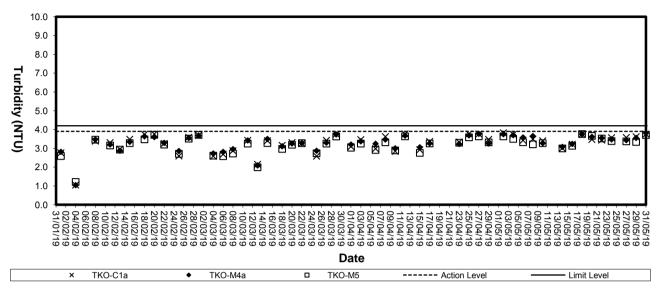



### Turbidity (Depth-average) at Mid-Flood Tide (3RS project)

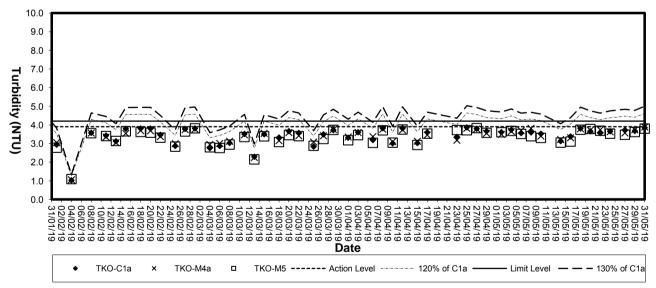

### Turbidity(Depth-average) at Mid-Ebb Tide (3RS project)



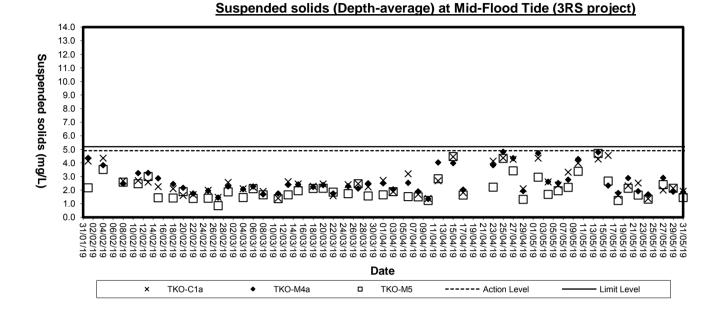

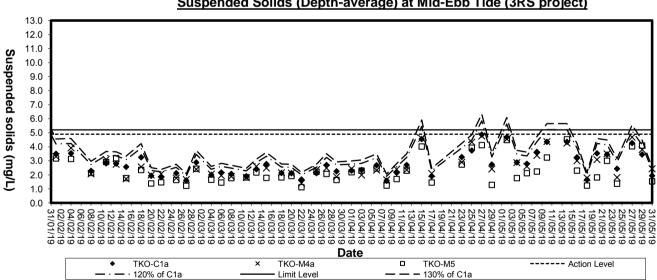

Suspended Solids (Depth-average) at Mid-Ebb Tide (3RS project)



Appendix E

Weather Condition

Day	Mean Pressure (hPa)		Air Temperat		Mean Dew Point	Mean Relative Humidity	Total Rainfall (mm)	Prevailing Wind Direction	Mean Wind Speed
2 4 9		Absolute Daily Max	Mean (deg. C)	Absolute Daily Min	(deg. C)	(%)		(degrees)	(km/h)
1	***	***	***	***	***	***	***	***	***
2	***	***	***	***	***	***	***	***	***
3	***	23.1#	22.3#	19.4#	17.4#	74#	0.0#	060#	7.1#
4	***	23.2	22.0	20.1	17.6	77	9.0	050	7.9
5	***	21.7#	20.8#	20.4#	20.2#	96#	18.0#	020#	8.3#
6	***	21.9#	20.6#	19.5#	19.5#	93#	12.0#	020#	7.9#
7	***	20.7	19.8	18.6	18.0	89	27.0	040	8.7
8	***	20.6	19.8	19.3	17.9	89	23.5	040	8.6
9	***	25.5	22.3	19.6	20.5	90	6.5	060	4.9
10	***	26.6	23.1	21.1	21.2	89	0.5	010	3.4
11	***	29.0	24.3	20.9	20.2	80	0.0	020	6.0
12	***	27.5	24.5	22.2	21.2	82	0.0	020	8.1
13	***	24.8	23.9	22.9	22.7	93	0.5	010	3.8
14	***	30.4	26.5	23.8	24.2	88	0.0	190	4.3
15	***	29.9	27.1	24.9	25.4	91	0.0	190	3.6
16	***	32.3	29.2	27.1	25.4	81	0.0	200	8.5
17	***	31.8	29.3	27.8	25.4	80	0.0	200	8
18	***	32.8	29.5	27.6	25.7	80	1.0	190	7.3
19	***	33.0	30.1	28.4	25.9	79	0.0	190	7.5
20	***	32.4	28.3	23.7	25.8	87	5.0	190	4.7
21	***	25.6	24.2	21.5	21.1	83	10.0	040	7.7
22	***	27.7	24.4	21.5	21.6	85	0.5	010	6.3
23	***	25.0	24.5	23.9	23.8	96	32.0	010	5.0
24	***	25.2	24.3	23.6	23.0	92	1.5	040	6.4
25	***	27.8	26.1	24.5	24.6	92	0.5	110	6.6
26	***	27.6	25.7	23.9	24.8	95	15.0	010	2.8
27	***	27.3	25.9	24.6	25.3	96	36.0	360	2.3
28	***	26.8	25.1	24.0	24.5	97	22.5	060	2.8
29	***	24.8	23.7	22.9	22.9	95	13.5	020	6.3
30	***	24.2	23.4	22.6	22.2	93	7.0	010	6.7
31	***	26.5	24.9	24.1	24.2	96	7.5	010	2.7

## Daily Extract of Meteorological Observations , May 2019 - Tseung Kwan O

\*\*\* unavailable

# data incomplete

Rainfall measured in increment of 0.5 mm. Amount of < 0.5 mm cannot be detected



Appendix F

**Event-Action Plans** 

5. Assess the effectiveness of 5. Supervise implementation of remedial
--

東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

ACTION         ET Leader         ACTION         ER         Contractor           2. Exceedance         1. Identify source, Investigata the causes of exceedance and propose namedial extremo         1. Discuss amongst ER, ET and Contractor on of exceedance and propose namedial of exceedance and propose namedial diffection         1. Confirm receipt of notification of rations         1. Take immediate action to evol frainer exceedance actions to the mode with the ICIE). EX EPD and Contractor none         2. Notify Contractor of rations         3. Notify Contractor actions to the mode with the ICIE). EX PD and Contractor noting         3. Notify Contractor actions to the mode with the ICIE). EX PD and Contractor noting         3. Notify Contractor actions to the mode with the ICIE). EX PD and ER to ontractor to the mode with ICIE) and ER to from the exceedances to be working procedance to implemented         3. Supervise the remediat actions to be mode with ICIE) and ER to ontractor to the totactor to the mode of the relevant actions to the exceedance to the totactor of the relevant action to the exceedance to action at modifier what portion of the exceedance to action at modifier what portion of the totactor to the totactor of work until the exceedance to abter mode of the relevant actions and the relevant actions actorelevance to the totactor of work at differed actions action at	EVENT				EVENTIACTION PLAN FOR AIR QUALITY EXCEEDANCE	Ę	Y EXCEEDANCE			
ET Leader         IC(E)         ER           1. Identify source, inwestigate the causes of exceedance and propose namedial de exceedance and propose namedial de exceedance and propose namedial measures         1. Discuss amongst ER, ET and Contractor on of exceedance and propose namedial measures         1. Discuss amongst ER, ET and Contractor on of exceedance and propose namedial measures         1. Discuss amongst ER, ET and Contractor on of exceedance and propose namedial measures         1. Discuss amongst ER, ET and Contractor on of exceedance and propose namedial measures         1. Discuss amongst ER, ET and Contractor on of exceedance and propose namedial measures         1. Discuss amongst ER, ET and Contractor on of failure in writing         2. Notity Contractor         2.           3. Respect measurement to confirm finding         3. In consultation with the IC(E), and failure in writing         3.         4.         4.           4. Increase monitoring frequency to daity finding         5. Cerry out aneities of monitors frequency to daity frequencies         3.         6.         4.           5. Cerry out aneities of contractor finding         3.         6.         4.         6.         5.           6. Arrange meeting with IC(E) and ER to focusts the remedial actions to be file         3.         6.         6.         6.           7. Assess effectiveness of Contractor's file         6.         6.         6.         6.         6.           8. if exceedance stops, cease additional monitoring         6.	_				ACTION					-
1.       Identify source, Investigate the causes of accordance and propose nemediat the causes of accordance and propose nemediat the contractor on acceedance and propose nemediat the potential remediat actions of acceedance and propose nemediat       1.       Discuss amongst ER, ET and Contractor on the mediations of acceedance and propose nemediations the potential remediat actions of acceedance and propose nemediation with Interception of talknee in writing       1.       Discuss amongst ER, ET and Contractor on the potential remediatial actions of acceedance and propose nemediations of talknee in writing       1.       Discuss amongst ER, ET and Contractor on the potential remediatial actions to defaultion with Interception of talknee in writing       2.       Notify Contractor on the potential remediatial actions to defaultion with the Contractor on the potentiane actions to be implemented for the potential actions to be taken.       2.       Notify Contractor on the contractor on the contractor on the potential measures to be implemented for the potential actions to be taken.       3.       In consultation with the Contractor on the contractor on the potential measures to be implemented for the potential measures to be implemented for the potential actions and keep to consider what portion of the work is responsible and the results.       4.       Ensume remediating the contractor on the potential measures to be implemented for the contractor on the work is responsible and instruct the contractor to stop that portion of work until the exceedance is abaled monitoring.       5.       If exceedance is abaled for the contractor to stop that portion of the exceedance is abaled for the contractor to stop that portion of work until the exceedance is abaled for the portion of the work until the exceedance is abaled for the portion o				ET Leader	1C(E)		ER		Contractor	-
o or     of exceedance and propose numedial measures     the potential remedial actions measures     2.     Nolify C(E), ER, EPD and Contractor measures     2.     Nolify C(E), ER     2.     Nolify C(E), ER     2.       6.     Inding     3.     Supervise the implemented measures     3.     1.	2. Exceedan	8	÷.	dentify source, investigate the causes	1. Discuss amongst ER, ET and Contractor on	÷	Confirm receipt of notification	÷	Take immediate action to	-
measures         2.         Nolify IC(E), ER, EPD and Contractor         2.         Review Contractor         2.         Nolify C(E), ER, EPD and Contractor         2.         Nolify IC(E), EPD and Contractor         2.         Nolify IC(E), EPD and Contractor         2.         Nolify IC(E), EPD and ER         2.         Nolify IC(E), EPD and Contractor         2.         Nolify IC(E), EPD and ER         3.         3.         Nonsultation with the IC(E), and ER         3.         3.         3.         3.         Nonsultation with the IC(E), and ER         3.<	for two or		0	if exceedance and propose remedial	the potential nemedial actions		of failure in writing		avoid further exceedances	
Bits         2. Notify IC(E), ER, EPD and Contractor finding         3. In consultation with the IC(E), finding         1. In consultation with the IC(E), finding         3. Supervise the implemented implemented         3. In consultation with the IC(E), finding         3. In consultation of the remedial measures finding         3. In consultation of the remedial measures finding         3. In consultation of the remedial measures finding         4. Increase confinetes finding         4. Increase confinetes finding         5. In consultation of the remedial measures finding         5. In consultation of the remedial measures finding         5. In consultation of the remedial measures finding	more		E	nedsurbs	<ol><li>Review Contractor's remedial actions</li></ol>	esi	Notify Contractor	e i	Submit proposals for remedial	70
<ol> <li>Repet mesurement to confirm finding</li> <li>Repet mesurement to confirm</li> <li>Repet mesurement to confirm</li> <li>Increase monitoring frequency to daily for transfer monitoring frequency to daily</li> <li>Carry out analysis of contractor's working procedures to determine possible mitigation to be implemented</li> <li>Arrange meeting with IC(E) and ER to discuss the remedial actions to be discuss the remedial actions to be discuss the remedial actions to be taken</li> <li>Research of the messures</li> <li>Arrange meeting with IC(E) and ER to discuss the remedial actions to be discuss the remedial actions to be taken</li> <li>Research of the remedial actions and keep IC(E), EPD and ER informed of the results</li> <li>Research of the results</li> <li>Research of the results</li> </ol>	consecutiv		~	totily IC(E), ER, EPD and Contractor	whenever necessary to assure their	eż	In consultation with the IC(E),		actions to IC(E) within 3	
finding finding frequency to daily carry out smallysis of contractor's working procedures to determine possible mitigation to be implemented Arrange meeting with IC(E) and ER to discuss the remedial actions to be discuss the remedial actions to be discuss the remedial actions and keep IC(E), EPD and ER informed of the vertice to stope, cease additional fracting that portion of work is responsible and instruct the Contractor to stope, cease additional fracting monuloring arrangement is abated fracting that portion of work is abated fracting that portion of work is responsible and instruct the Contractor to stope, cease additional fracting arrangement is abated fracting that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible and instruct the contractor to stope that portion of work is responsible.	samples	~		tepeat messurement to confirm	effectiveness and advise the ER accordingly		agree with the Contractor on		working days of notlication	
Increase moniforing frequency to daily contraster moniforing frequency to daily contractor's working procedures to determine possible mitigation to be implemented Arrange meeting with IC(E) and ER to discuss the remedial actions to be discuss the remedial actions to be discuss the remedial actions and keep IC(E), EPD and ER informed of the exceedance stops, cease additional monitoring monitoring measures are accessed and actions to be exceedance is abated actions to be exceedance is abated actions to be accessed activity and activity act			æ	inding			the remedial measures to be	eș	Implement the agreed	-
Cerry out analysis of contractor's working procedures to detormine working procedures to detormine possible mitigation to be implemented Arrange meeting with IC(E) and ER to discuss the remedial actions to be discuss the remedial actions to be discuss the remedial actions and keep IC(E), EPD and ER informed of the work is responsible and taken		4	-	a monitoring	measures		implemented		proposals	-
working procedures to determine possible mitigation to be implemented Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken Assess effectiveness of Contractor's Assess effectiveness of Contractor's Assess effectiveness of Contractor's and ER informed of the results if exceedance stops, cease additional monitoring		ŝ	-	Sarry out analysis of contractor's		٩ŕ	Ensure remedial measures	Ť	Resubmit proposals if	-
possible mitigation to be implemented Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken Assess effectiveness of Contractor's Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results if exceedance stops, cease additional monitoring			*	vorking procedures to determine			are property implemented		problem still not under control	-
Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken Assess effectiveness of Contractor's Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results if exceedance stops, cease additional monitoring			6	ossible mitigation to be implemented		ς'n	If exceedances confinues,	цź	Stop the relevant activity of	-
discuss the remedial actions to be taken work is responsible and taken taken and taken and taken and taken and keep IC(E), EPD and ER informed of the results and taken actions and keep IC(E), EPD and ER informed of the results and taken actions actions and taken actions actions and taken actions actio		0		vrange meeting with IC(E) and ER to			consider what portion of the	_	works as determined by the	-
taken instruct the Contractor to step transformedial actions and keep (C(E), EPD ended actions and keep (C(E), EPD end ER informed of the results if exceedance stops, cease additional monitoring			9	liscuss the remedial actions to be			work is responsible and		ER until the exceedance is	-
Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results if exceedance stops, cease additional monitoring			3	ektern			instruct the Contractor to stop		abated	-
remedial actions and keep IC(E), EPD - and ER informed of the results if exceedance stops, cease additional monitoring		-		kases effectiveness of Contractor's			that portion of work until the			-
and ER informed of the stops, the monitoring of the stops, the stops of the stops of the stops of the stop of the			2	emedial actions and keep IC(E), EPD			exceedance is abaled			
lif exceedance stops, monitoring			40	and ER informed of the results						-
monitoring								_		_
			E	nonttoring						7

東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

Y

EVENT									_
				ACTION	NO				
		ET Leader		IC(E)	L	ER		Contractor	- 7
Level	ಗಳ ಸ್	Notify the IC(E) and the Contractor. Carry out investigation. Report the results of investigation to the IC(E) and the Contractor and Discuss with the Contractor and formulate remedial measures. Increase monitoring frequency to check miligation effectiveness	r' 61 61	Review the amalysed results submitted by the ET. Review the proposed remedial measures by the Contractor and advise the ER accordingly. Supervise the implementation of remedial measures.	ને લોલે 4	Confirm receipt of notification of failure in writing. Notify the Contractor to propose Require the Contractor to propose remedial measures for the snetysed noise problem. Ensure remedial measures are property implemented.	<del>,</del> v	Submit noise miligation proposals to IC(E). Implement noise miligation proposals.	
, Lmit	÷		÷	Discuss amongst the ER, the ET	÷	Confirm receipt of notification of follows to write or	÷.	Take immediate action to avoid futbar avcandance	
n and	~	and the Contractor.		Leader and the Contractor on the rotantial tempetial sections.	e	Notify the Contractor.	2		_
	ici		N	Review the Contractor's remedial	ાં ભ	Require the Contractor to propose	i		
		-		actions whenever necessary to		remedial measures for the		working days of notification.	
	÷.			assure their effectiveness and		analysed noise problem.	ri.	Implement the agreed	
	ń	working procedures to determine	e	summente the inclementation of	ŕ	property implemented.	4	Resubmit proposals if problem	
		possible miligation to be	;	remedial measures.	ьć	If ecceedances continue, consider		still not under control.	
						what activity of the work is	က်	Stop the relevant activity of	-
	ó	EDD eta restatas & actions taken for				Destructure allo rearrow une Contractor to store that activity of		worke as determined by all Cry	
		the exceedances.				work until the exceedances is		abated.	_
	r,					abshed.			
		Contractor's remedial actions and							
		keep the IC(E), the EPD and the							-
	œ	EK informed of the results If avoandance due to the							
	ś				_				
		additional monitoring							

EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE	ER		<ol> <li>Nolify EPD and other relevant</li> <li>1. 0</li> </ol>	of governmental agencies in writing			2. Discuss with IEC, ET and	8	days of mitigation measures; Contractor on the mitigation	<ol><li>Require contractor to propose</li></ol>	Ń	king analysed problem if related to the mitigation measures	construction works	<ol> <li>Ensure remodial measures are ensure their effectiveness</li> </ol>		5. Assess the effectiveness of the	mitigation measure 5. 8		aton of measures .		tigation	ble time			
AND ACTION PLAN	Contractor	1		within 24 hours of identification of	exceedance				and ER within 3 working days of	the identification of an	encedance	Consider changes of working	method if exceedance is due to	the construction works	Discuss with ET, IEC and ER and	propose mitigation measures to	IEC and ER if exceedance	to the construction works within 4	working days of identification of	an exceedance	<ul> <li>Implement the sgreed mitigation</li> </ul>	measures within reasonable time	scale		
ENT			γ <sup>2</sup>			-	ei		تريد			ú	8	8	¢		2		ş		<u>کر</u> 14		1ay		
EV	RT Laster		Identify source(s) of impact;	Repeat in-situ measurement to	confirm findings:			exceedance			working methods:			to the Contractor within 3 working	days of identification of	exceedance and advise	contractor if exceedance is due to	contractor's construction works	<ul> <li>Discuss miligation measures with</li> </ul>	Contractor if exceedance is due	to the construction works within 4	working days	<ul> <li>Repeat measurement on next day</li> </ul>	of exceedance if exceedance is	due to the construction works
		4		e i		ei			4			uş	യ		_				1-				ග්		
Event			Action level	being exceeded	by one	sampling day																			

東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

P

ActToN         ActToN           fimpact, surrement         1. Notify IEC and ER in writing surrement         1. Notify IEC and ER in writing writing writing at hours of dentification of exceedance         1. Notify IEC and Other relevant         1.           surrement         aurement         1. Notify IEC and ER in writing dentification of exceedance         1. Notify IEC and CR         2.           writing         3. Check all plant and dentification of exceedance         1. Notify IEC and ER         3.           an ethods:         5. Submit the results of the equipment;         2.         Discuss with IEC, ET and miligation neasures;         3.           of the bin         4. Consider dranges of working days of the investigation to IEC and ER         3.         Require contractor of the econtractor of the property implemented investigation of an ection         3.           ys of to         0.         Discuss with ET, IEC and ER         4.         Ensure remedial measures are properly implemented intertification of an ecceedance         4.         Ensure remedial measures are properly implemented intertification of an ecceedance         5.           oution to         1.         Implement the agreed intertification of an ecceedance         5.         5.           oution of to         2.         Discuss with an ecceedance         6.         5.           oution of to         3.         Discuss with an eccoedance         6. </th <th>Event</th> <th></th> <th></th> <th></th> <th>EVENT AND ACTION PLAN FOR WATER QUALITY</th> <th>5</th> <th>DR WATER QUALITY</th> <th></th>	Event				EVENT AND ACTION PLAN FOR WATER QUALITY	5	DR WATER QUALITY	
ET Leader         Contractor         ER           Ieweil         1. Identify seurice(s) of impact.         Notify ED and other relevant         1.           ded by         2. Repeat in-glu measurement         within 24 hours of optimer seturement         Notify ED and other relevant         1.           ded by         3. Notify Contractor in writing         2. Rectify unacceptable practice, other identification of the identification of the identification of the contractor in writing         2. Check monitoring data, all writing writin 24 hours of the identification         3.         Check for and ER         3.           6.         Report the results of investigation of the remedial measures; contractor if and advise contractor if and propose milgation an exceedance         4.         A.           0.         Pisater the investigation measures         5.         Assess the effectiveness of the contractor if and advise contractor if measures         5.           1.         Discuss with ET, IEC and ER investigation and advise contractor if measures         6.         1.         1. <th></th> <th></th> <th></th> <th></th> <th>ACTIC</th> <th>Ň</th> <th></th> <th></th>					ACTIC	Ň		
<ol> <li>Identify source(s) of impact, indext indext in the second merine indext in the source of the second merine indext in the second merine indext in the second merine indext in the second merine indext indext in the second merine indext i</li></ol>			ET Leader		Contractor	_	ж	IEC
2. Repeat In-sllur measurement       within 24 hours of the two of exceedance       2. Repeat In-sllur measurement       2. Repeat In-sllur measurement       2. Submit Noticy concernents       3. Consider the measurement       3. Construction       3. Construction       4. Check all plant and       5. Clarry out insertories of the interstures; for the integration to the construction works       4. Check all plant and       5. Clarry out insertories of the integration measures; for the integration of the construction of and       5. Construction of the construction works       4. Construction of the construction works       5. Construction of the construction works       5. Construction of the construction works       5. Cons	Action level	÷	Identify source(s) of impact;	÷	Notify IEC and ER in writing	ų.		<ol> <li>Check monitoring data</li> </ol>
<ol> <li>Notity Contractor in writing within 24 hours of the viting within 24 hours of identification</li> <li>Notity Contractor in writing</li> <li>Check monitoring data, all</li> <li>Check monitoring data, all</li> <li>Check monitoring data, all</li> <li>Consider changes of working</li> <li>Contractor swriting methods;</li> <li>Consider changes of working days of the infigation measures;</li> <li>Carry out investigation to the Contractor</li> <li>Report the results of investigation to the Contractor on the proposed mediating advise construction of exceedance and advise construction of exceedance indentification of an exceedance indentification of an exceedance within 1 4 working days of the miligation measures of the medial measures of the monitoring advise contractor within 1 4 working days of the miligation measures for the construction works with IEC and Contractor within 1 4 working days of the miligation measures of the miligation measures of the miligation measures of the monitoring of exceedance are by furtherented are and advise contractor within 1 4 working days of the miligation measures of the miligation measures within IEC and Contractor within 1 4 working days of the miligation measures of the monitoring of dentification of an exceedance is further acale</li> <li>Bensam Mile IEC and CR</li> <li>Assess the effectiveness of the miligation measures of the monitoring frequence.</li> </ol>	being	ei	Repeat in-situ measurement		within 24 hours of		governmental agencies in	submitted by ET
3. Notify Contractor in writing writin 24 hours of montoring data, all montoring montoring data, all montoring mont	exceeded by		to confirm findings		identification of exceedance		writing within 24 hours of the	
within 24 hours of identification       3. Check all plant and identification       3. Check all plant and identification       3. Check all plant and plant equipment;       4. Consider changes of working methods;       3. Check all plant and methods;       3. Check all plant and proposed methods;       3. Check all plant and methods;       4. Consider changes of working methods;       4. Consider changes of working methods;       4. Constactor on the proposed methods;       3. Check all plant and methods;       4. Consider changes of working methods;       3. Check all plant and methods;       4. Consider changes of working methods;       4. Constactor the methods;       4. Constactor the methods;       4. Constactor the mediation of an exceedance       5. Submit the construction works       4. Construction works       5. Castor ER       <	more than one	eś	Notify Contractor In writing	2	Rectify unacceptable practice;		identification of the	if exceedance is due /
<ol> <li>Cherkification</li> <li>Check monitoring data, all plant, exuipment and contractor's working methods;</li> <li>Consider changes of working plant, exuiting methods;</li> <li>Contractor is contractor's working methods;</li> <li>Submit the results of methods;</li> <li>Submit the results of investigation to the Contractor on the proposed investigation to the Contractor of within 3 working days of the investigation to the Contractor within 3 working days of investigation to the Contractor within 3 working days of investigation to the Contractor within 3 working days of investigation to the Contractor within 3 working days of identification of en exceedance</li> <li>Discuss mitigation measures identification of en works</li> <li>Discuss mitigation measures and propose mitigation works</li> <li>Discuss mitigation measures in exceedance</li> <li>Discuss mitigation measures and secontractor within an exceedance</li> <li>Discuss mitigation measures in methods</li> <li>Discuss mitigation measures and propose mitigation works</li> <li>Discuss mitigation measures and propose mitigation measures and propose mitigation measures and propose mitigation measures are implemented;</li> <li>Discuss mitigation measures are implemented;</li> <li>Prepare to increase the monitoring frequency to daily davel exceedance</li> </ol>	consecutive		within 24 hours of	က်	Check all plant and		exceedance	not due to the works
Check monitoring data, all       4. Consider changes of working       Contractor on the proposed         plant, equipment and       5. Submit the results of       7. Require contractor to proposed         Contractor's working methods;       5. Submit the results of       7. Require contractor to proposed         Carry out investigation       7. Submit the results of       7. Require contractor to propose         Report the results of       6. Discuss within 3 working days of the       7. Require contractor works         within 3 working days of       6. Discuss with ET, IEC and ER       8. Ensure remedial measures         and advise contractor if       6. Discuss with ET, IEC and ER       8. Assess the effectiveness of         and propose miligation       6. Discuss within 4 working days of       6. Assess the effectiveness of         works       2. Discuss within 4 working days of       6. Assess the effectiveness of         works       7. Implemented       7. Implemented         Finaver antigation       7. Implemented       7. The miligation measures         resonstruction       6. Assess the effectiveness of       5.         Mith IEC and Contractor within       7. Implemented       6. Assess the effectiveness of         Montractor's construction       6. Assess the effectiveness of       5.         Montractoris       7. Implemented       7.	sempling days		identification	_	equipment;	N	in the	_
plant, equipment and contractor's working methods;     5. Submit the results of the remedial measures;     3. Require contractor to propose investigation to the Contractor to measures;     4.       Contractor's working days of investigation to the Contractor investigation to the Contractor investigation investigation to the Contractor investigation to the Contractor investigation investigation to the Contractor investigation investigation to the Contractor investigation investigation to the Contractor investigation investigation investigation to the Contractor investigation investigatinvestigation investigation investigation investigation i		÷	Check monitoring data, all	Ť	Consider changes of working		Contractor on the proposed	Contractor on the
Contractor's working methods:       5. Submit the results of the carry out investigation       3. Require contractor to propose investigation to the Contractor to propose investigation to the Contractor if within 3 working days of the interestingation of encellation of encelation of encellation of encellation of enc			plant, equipment and		methods;		miligation measures;	mitigation measures.
Carry out investigation Report the results of investigation to the Contractor within 3 working days of identification of en analysed problem if related to identification of en analysed problem if related to identification of en exceedance and advise contractor if exceedance and advise contractor if exceedance and advise contractor if exceedance identification of en exceedance identification of en exceedance identification of an works Discuss mitigation measures with IEC and ER working days of exceedance identification of an works Discuss mitigation measures with IEC and Contractor within te construction works Discuss mitigation measures with IEC and Contractor within the construction works exceedance identification of an exceedance Ensure mitigation measures identification of an exceedance Ensure mitigation measures identification of an exceedance identification of an exceedance inth IEC and Contractor within the construction works with IEC and Contractor within the mitigation measures with IEC and Contractor within the mitigation measures identification of an exceedance Ensure mitigation of an exceedance intervented the mitigation measures with IEC and Contractor within the mitigation measures with IEC and Contractor within the construction works identification of an exceedance Ensure mitigation of an exceedance intervented the construction works identification of an exceedance intervented the construction works identification of an exceedance intervented the construction with IEC and Contractor within the construction with IEC and Contractor within the construction identification of an identification of an identificat			Contractor's working methods;	uń.	Submit the results of the	es	Require contractor to propose	
Report the results of investigation to the Contractor within 3 working days of identification of the and advise contractor if and advise contractor if and advise contractor if and advise contractor if and propose miligation exceedance         within 3 working days of the identification of an exceedance         analysed problem if related to the construction works           within 3 working days of dentification of exceedance         6. Discuss with ET, IEC and ER and propose miligation exceedance         4. Ensure remedial measures are properly implemented are properly implemented are properly implemented are properly implemented within EC and CR with IEC and Contractor within tecsoures the monitoring of identification of an exceedance         5. Assess the affectiveness of the miligation measures are properly implemented are		ທ່	Carry out investigation		investigation to IEC and ER		remedial measures for the	mitigation measures
Investigation to the Contractor within 3 working days of and advise contractor if and advise contractor and propose mitigation exceedance contractor's construction works     4. Ensure remedial measures are properly implemented and propose mitigation measures to IEC and ER within 4 working days of identification of an works     4. Ensure remedial measures are properly implemented and propose mitigation measures to IEC and ER within 4 working days of identification of an exceedance with IEC and Contractor within an exceedance Ensure mitigation measures with IEC and Contractor vithin reasonable time scale     5. Assess the effectiveness of the mitigation measures are properly implemented for the mitigation measures are implemented.		ω	Report the results of		within 3 working days of the		analysed problem If related to	whenever necessary to
within 3 working days of identification of exceedance     6. Discuss with ET, IEC and ER and advise contractor if and propose mitigation exceedance is due to contractor's construction works     6. Discuss with ET, IEC and ER and propose mitigation messures to IEC and ER within 4 working days of identification of an works     4. Ensure remedial measures are properly implemented are properly implemented are properly implemented the mitigation measures with IEC and Contractor within a works     5.       The mitigation measures with IEC and Contractor within works     7. Implement the agreed mitigation measures with IEC and Contractor within an exceedance Ensure mitigation measures with IEC and Contractor within a working of Identification of an exceedance Ensure mitigation measures with IEC and Contractor within a exceedance Ensure mitigation measures with IEC and Contractor within a exceedance     4. Ensure remedial measures are properly implemented the mitigation measures with IEC and Contractor within treasonable time scale     5.			investigation to the Contractor		identification of an		the construction works	ensure their
Identification of exceedance and advise contractor if and propose mitigation and advise contractor if exceedance is due to contractor's construction works works mitigation measures to EC and ER and propose mitigation measures within EC and Contractor with IEC and Contractor with IEC and Contractor within EC and Contractor with EC and Contractor within the agreed and exceedance are implemented. Frepare to increase the monitoring frequency to daily, Repeat measurement on next day of exceedance.			within 3 working days of		exceedance	÷	Ensure remedial measures	effectiveness and advise
and advise contractor if and propose mitigation escondance is due to contractor's construction works contractor's construction works with IEC and Contractor within 4 working days of contractor within EC and Contractor within 4 working of identification of an exceedance within ET and properent of an exceedance and exceedance are implemented; Prepare to increase the mollocing frequency to daily; Repeat measurement on next			identification of exceedance	ø	Discuss with ET, IEC and ER		are properly implemented	the ER accordingly
exceedance is due to contractor's construction works works the mitigation measures with IEC and Contractor within the EC and Contractor within the EC and Contractor within the EC and Contractor within the mitigation measures with IEC and Contractor within the mitigation measures with IEC and Contractor within the mitigation measures with IEC and Contractor within the mitigation measures the scale the scale the mitigation measures the scale the mitigation measures the scale the mitigation measures the scale the scale the scale the mitigation measures the scale the mitigation measures the scale the scale the scale the scale the scale the scale the scale the scale the mitigation measures the scale the scale the scale the scale the sc			and advise contractor if		and propose mitigation	uś	Assess the effectiveness of	5. Assess the effectiveness
contractor's construction within 4 working days of identification of an works. with IEC and Contractor within a agreed with IEC and Contractor within the agreed ance exceedance and exceedance and exceedance are implemented; Prepare to increase the monitoring frequency to daily; Repeat measurement on next in a greed and the agreed			exceedance is due to		measures to IEC and ER		the mitigation measure	of the implemented
works Discuss mitigation measures with IEC and Contractor within 4 working of Identification of an exceedance Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; Repeat measurement on next day of exceedance.			contractor's construction		within 4 working days of			mitigation measures.
Discuss mitigation measures with IEC and Contractor within 7. I 4 working of Identification of an exceedance Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; Repeat measurement on next day of exceedance.			works		identification of an			I
with IEC and Contractor within 7. 1 4 working of Identification of an exceedance Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; Repeat measurement on next day of exceedance.		<u>к</u>	Discuss mitigation measures		exceedance			
4 working of Identification of an exceedance Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; Repeat measurement on next day of exceedance.			with IEC and Contractor within	Þ.				
an exceedance Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily, Repeat measurement on next day of exceedance.			4 working of Identification of		mitigation measures within			
			an exceedance		reasonable time scale			
		œ	Ensure mitigation measures					
			are implemented;					
		σ	Prepare to increase the					
day of exceedance.		6						
			day of exceedance.					



Event		EVEN	E	EVENT AND ACTION PLAN FOR WATER QUALITY EXCEEDANCE	ATI	ER QUALITY EXCEEDANCI	ш	
	_			ACTION	z			
		ET Leader	Ц	Contractor		ER		IEC
Limit level		Repeat in-situ measurement		. Notify IEC and ER in writing:	÷	_	÷	Check monitoring data
being	_	to confirm findings;		within 24 hours of the		governmental agencies in		submitted by E1
exceeded by	Ň			identification of the	_	writing within 24 hours of	N	Confirm ET assessment
one sampling	e		_	exceedance	_	identification of exceedance		if exceedance is due /
dav	5		r,		ŝ	Discuss with IEC, ET and		not due to the works
600		identification of the	eó	-	_	Contractor on the proposed	ei	Discuss with ET, ER and
		exceedance		equipment;		mitigation measures;		Contractor on the
	4		÷	Ξ.	က်	Request Contractor to critically		-
		plant, equipment and	_	methods;		review the working methods;	٩ŕ	
		Contractor's working methods:	ю	Submit the results of the	Ý	Ensure remedial measures		milligation measures
	ú		_			are properly implemented	_	submitted by Contractor
	ί¢		_	within 3 working days of the	цó	Assess the effectiveness of		and advise the ER
	i .			identification of an		the implemented miligation		
	_	within 3 working days of		exceedance	_	measures.	ω	
		identification of exceedance	φ	<ul> <li>Discuss with ET, IEC and ER</li> </ul>				of the implemented
		and advise contractor if						mitigation measures
		exceedance is due to		measures to IEC and ER			_	
		contractor's construction		within 4 working days of the	_			
		works		identification of an	_			
	ř	Discuss mitigation measures	_	_				
	_	with IEC, ER and Contractor	~	<ol><li>Implement the agreed</li></ol>				
		within 4 working of		miligation measures within				
		identification of an	_	reasonable time scale	-			
	_	exceedance			_			8
	œ	Ensure mitigation measures						
	_	are implemented;			_			
	á							
		frequency to daily until no						
		exceedance of LIMIT Level.	-		1		ł	



				ACTION	N			
		ET Leader	L	Contractor	L	ER		IEC
Limit Level	-	Recest in-situ measurement	÷	Notify ER and IEC in writing	÷	Notify EPD and other relevant	÷	Check monitoring data
being		to confirm findings:		within 24 hours of the		governmental agencies in		submitted by ET
avranded hv	\$	Identify source(s) of impact:	_	identification of the		writing within 24 hours of	N	Confirm ET assessment
more than one	i e		_	exceedance and		Identification of exceedance		if exceedance is due /
and the user one	5		5	Rectify unacceptable practice:	ŝ	Discuss with IEC, ET and		not due to the works
consecutive compline date		Muttin 24 Floure Of	i e	Check all plant and		Contractor on the proposed	ę	Discuss with ER, ET and
edan fuurfuise			i	equipment:		mitigation messures;		Contractor on the
	4	Check monitoring data, all	٩	Consider changes of working	ભં	Request Contractor to critically		miligation measures.
	-	plant accibment and		methods:		review the working methods;	ŧ	Review proposals on
		Contractor's working methods:	-00	Submit the results of the	ശ്	Ensure remedial measures		mitigation measures
	u2	Cerv out investingion		investigation to IEC and ER		are properly implemented		submitted by Contractor
	śœ	Report the results of	_	within 3 working days of the	Ť	Assess the effectiveness of		and advise the ER
	i	investination to the Contractor		identification of an		the implemented mitigation		accordingly.
		within 3 working days of		exceedance	_	measures;	ю	Assess the effectiveness
	_	identification of exceedance	чó	Discuss with ET, IEC and ER	ъ	Consider and instruct, if		of the implemented
	_	and advise contractor if		and propose mitigation		necessary, the Contractor to		mitigation measures.
		exceedance is due to		messures to IEC and ER		slow down or to stop all or part		
		contractor's construction		within 4 working days;		of the marine work until no		
		works	ώ	Implement the agreed		exceedance of Limit Level.		
	۲.	Discuss mitigation measures	worther	mitigetion measures within				
		with IEC, ER and Contractor,		reasonable time scale				
	න්	Ensure mitigation measures	ř	As directed by the Engineer,				
		are implemented;		to slow down or to stop all or				
	ல்	Increase the monitoring		part of the marine work or				
		frequency to daily until no		construction actives.			_	
		exceedance of Limit Level for					_	
	_	two consecutive days.	_		_			



Appendix G

Works Programme

Three Months Rolling Programme (1-June-2019 to 31-August-2019)

						T
Item	Description	From	То	Jun-19	Jul-19	
1	Section 1A	1-Jun-19	10-Jul-19	i     -     3     6     i     8     9     10     11     12     13     14     15     16     17     18     19     20     21     22     23     24     25     26     27     28     29     30	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31	1 2
1.1	Operation of Fill Bank, surveillance system and tipping halls	1-Jun-19	10-Jul-19			
	Operation of crushing plants	1-Jun-19	10-Jul-19			
	Operation of the existing and expanded dewatering plants	1-Jun-19	10-Jul-19			
	Collection and delivery of Public Fill from CWPFBP and MWPFRF to TKOFB	1-Jun-19	10-Jul-19			
1.5	Breaking up the incoming precast concrete units	1-Jun-19	10-Jul-19			
1.6	Carry out repair works for damages caused by Super Typhoon	1-Jun-19	10-Jul-19			
1.7	Carry out preliminary sorting on Public Fill for Three Runway System (3RS) project	1-Jun-19	10-Jul-19			
2	Section 2A	1-Jun-19	10-Jul-19			
2.1	Operation of Fill Bank, surveillance system and tipping halls	1-Jun-19	10-Jul-19			
2.2	Breaking up the incoming precast concrete units	1-Jun-19	10-Jul-19			
2.3	Operation of glass cullet storage compartment at Portion B7	1-Jun-19	10-Jul-19			
2.4	Construction of transformer room and meter room	1-Jun-19	10-Jul-19			
2.5	Carry out preliminary sorting on Public Fill for Three Runway System (3RS) project	1-Jun-19	10-Jul-19			
	Section 3	1-Jun-19	30-Jun-19			
3.1	Design and construction of of seawalls at Zone B (approx. 900m)	1-Jun-19	30-Jun-19			
4	Section 3A	1-Jun-19	30-Jun-19			
	Design, construction and operation of new berthing facilities at Zone B	1-Jun-19	30-Jun-19			
4.2	Design, construction and operation of new navigation channel and turning basin inassociated with the berthing facilities at Zone B	1-Jun-19	30-Jun-19			
4.3	Design and construction of seawalls at Zone B (approx. 1500m)	1-Jun-19	30-Jun-19			-
5	Section 4	1-Jun-19	31-Aug-19			111 2
	Collection and delivery of Public Fill to the Designated Reclamation Sites in the Mainland	1-Jun-19	31-Aug-19			
6	Section 6	1-Jun-19	31-Aug-19			
6.1	Removal of existing stockpiled Public Fill at Portion A5b down to +5.2mPD	1-Jun-19	31-Aug-19			
	Section 7	1-Jun-19	20-Jun-19			
	Removal of existing stockpiled Public Fill at Portion A5c down to +5.2mPD and +5.2mPd/+6.0mPD	1-Jun-19	20-Jun-19			-

Aug-19
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31



Appendix H

Weekly ET's Site Inspection Record

#### CEDD Contract No.: CV/2015/07




Handling of Surplus Public Fill (2016-2018) - Tseung Kwan O Area 137 Fill Bank

: 08/05/2019 : 15:00 Inspection Date Time : Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy Weather Wind

:

Temperature

Humidity

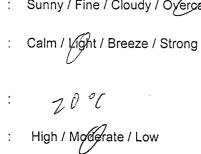

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:	V	Spec	jaco
Name:	Ten toa nj	Shry	Ciao Un Oreo
Title	Bu	R	6-7



Environmental Checklist			ation *	Remark
		No		
Fugitive Dust Emission				
<ul> <li>Dust control / mitigation measures shall be provided to prevent dust nuisance.</li> </ul>	V			
A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	V			
Water sprays shall be provided and used to dampen materials.	$\checkmark$			· · · · · · · · · · · · · · · · · · ·
<ul> <li>Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.</li> </ul>	$\checkmark$			
<ul> <li>All vehicles shall be restrict to a maximum speed of 10 km per hour.</li> </ul>				
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	V			
The designated site main haul road shall be paved or regular watering.	$\checkmark$			
<ul> <li>Frequent watering of work site shall be at least three times per day.</li> </ul>	$\checkmark$			n na
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	$\checkmark$			
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.				····-
All plant and equipment should be well maintained e.g. without black smoke emission.	$\checkmark$			
Open burning should be prohibited.	$\checkmark$			
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> </ul>	V			
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	V			
When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	$\checkmark$			
The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.				
The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	V			
<ul> <li>Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non- road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).</li> </ul>	V			
Noise Impact				
The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	V			
Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.				
Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	1			
Air compressors and hand held breakers should have noise labels.				
<ul> <li>Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.</li> </ul>	√			· · · · · · · · · · · · · · · · · · ·
<ul> <li>Noisy equipment and mobile plant shall always be site away from NSRs.</li> </ul>	, ,			



Environmental Checklist				Remark	
	Yes	No	N/A		
Water Quality					
<ul> <li>Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.</li> </ul>					
<ul> <li>The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.</li> </ul>	$\checkmark$				
<ul> <li>Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.</li> </ul>	V				
<ul> <li>Manholes should be covered and sealed.</li> </ul>					
<ul> <li>Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.</li> </ul>					
<ul> <li>A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.</li> </ul>	$\checkmark$				
<ul> <li>A buffer distance of at least 20m shall be maintained between the boundary of the C&amp;DMSF and the seafront.</li> </ul>					
<ul> <li>The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.</li> </ul>				· · · · · · · · · · · · · · · · · · ·	
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> </ul>	V				
<ul> <li>Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> </ul>	V				
<ul> <li>Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.</li> </ul>	V				
<ul> <li>A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.</li> </ul>	V				
<ul> <li>The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.</li> </ul>	V				
<ul> <li>Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.</li> </ul>	V				
<ul> <li>Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.</li> </ul>	$\checkmark$				
Oil interceptor shall be provided at work shop.	$\checkmark$				
<ul> <li>Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.</li> </ul>	$\checkmark$				
<ul> <li>The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.</li> </ul>	V				
<ul> <li>All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.</li> </ul>	V				
<ul> <li>Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.</li> </ul>	$\checkmark$				
<ul> <li>Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.</li> </ul>	V				
<ul> <li>The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.</li> </ul>	V				
<ul> <li>Existing silt curtain at the outward side of the basin near the Barging Handling Area (BHA) throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.</li> </ul>	V				
<ul> <li>A waste collection vessel shall be deployed to remove floating debris.</li> </ul>	$\checkmark$				



Environmental Checklist				Remark
	Yes	No	N/A	
Landscape and Visual				
<ul> <li>The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> </ul>	1			
<ul> <li>The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.</li> </ul>	$\checkmark$			
<ul> <li>Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> </ul>	$\checkmark$			
<ul> <li>The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	1			
Other Environmental Factors				
<ul> <li>C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> </ul>	V			
<ul> <li>Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnece ssary generation of waste.</li> </ul>	$\checkmark$			
<ul> <li>Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> </ul>				
All generators, fuel and oil storage are within bundle areas.				
Oil leakage from machinery, vehicle and plant is prevented.		+		
The Environmental Permit should be displaced conspicuously on site.				
<ul> <li>Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> </ul>	V			
<ul> <li>To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	V			




## Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Follow up Date

# Remark

	Name	Title	Signature	Date
Checked by	Frankie Tang	ET Representative	and the	08 May 2019

### CEDD Contract No.: CV/2015/07



■ 東業德勤測試顧問有限公司 ■ ETS-TESTCONSULT LTD.

Inspection Date	:	15/05/19
Time	:	N: O P
Weather	:	Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
Wind	:	Calm / Light / Breeze / Strong

Temperature

Humidity



Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:	Aznone	A	Na
Name:	Zoone pour mus	Sansur	Cintuda
Title	Acon	Elo	E.T



	Environmental Checklist			tation s*	Remark	
				N/A		
Fugitive	Dust Emission					
<ul> <li>Dust</li> </ul>	control / mitigation measures shall be provided to prevent dust nuisance.					
<ul> <li>A bu Estal</li> </ul>	ffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial te. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	V				
Wate	er sprays shall be provided and used to dampen materials.	$\checkmark$				
r Regu	lar cleaning and watering the site shall be provided to minimize the fugitive dust emissions.					
All ve	chicles shall be restrict to a maximum speed of 10 km per hour.					
and t	vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be red by a clean tarpaulin.	V	:			
The	designated site main haul road shall be paved or regular watering.	$\checkmark$				
	uent watering of work site shall be at least three times per day.					
	el washing facilities including high-pressure water jet shall be provided at the entrance of work site.					
	y vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.					
	ant and equipment should be well maintained e.g. without black smoke emission.	$\checkmark$				
	n burning should be prohibited.					
The wate	temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with r or protected by other method approved by CEDD.	$\checkmark$				
	slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation ing or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	V				
Whe	n fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	$\checkmark$				
The l	belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.					
	level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing is maintained at no more than 1m.	V				
road	oval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non- vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO 311).	V				
Noise Im	pact					
The adap	approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be ted.	V				
	well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.					
Powe	ered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.					
Air c	ompressors and hand held breakers should have noise labels.					
Macł	nines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.					
	y equipment and mobile plant shall always be site away from NSRs.	V			· · · · · · · · · · · · · · · · · · ·	



Environmental Checklist				Remark	
	Yes	No	N/A		
Water Quality					
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	1				
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	V				
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	√				
Manholes should be covered and sealed.	$\checkmark$				
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.	1				
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.					
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.					
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.			1		
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> </ul>	V				
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√				
Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.	V				
A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.	√				
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	1		-	· · · · · · · · · · · · · · · · · · ·	
Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.	V				
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	1				
Oil interceptor shall be provided at work shop.	$\checkmark$				
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.	√				
The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.					
<ul> <li>All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.</li> </ul>	V				
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.	$\checkmark$				
<ul> <li>Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.</li> </ul>	√				
The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.	V				
Existing silt curtain at the outward side of the basin near the Barging Handling Area (BHA) throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.					
<ul> <li>A waste collection vessel shall be deployed to remove floating debris.</li> </ul>	√				



Environmental Checklist				Remark
	Yes	No	N/A	
Landscape and Visual				
<ul> <li>The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> </ul>	V			
<ul> <li>The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.</li> </ul>	$\checkmark$			
<ul> <li>Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> </ul>	V			· · · · · · · · · · · · · · · · · · ·
<ul> <li>The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	V			
Other Environmental Factors				
<ul> <li>C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> </ul>	√			
<ul> <li>Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnece ssary generation of waste.</li> </ul>	$\checkmark$			
<ul> <li>Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> </ul>	$\checkmark$			
All generators, fuel and oil storage are within bundle areas.				
Oil leakage from machinery, vehicle and plant is prevented.		1		
The Environmental Permit should be displaced conspicuously on site.	√			
<ul> <li>Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> </ul>	$\checkmark$			
<ul> <li>To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	V			



## Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Follow up Date

Remark

	Name	Title	Signature	Date
Checked by	Frankie Tang	ET Representative		15 May 2019

### CEDD Contract No.: CV/2015/07





Inspection Date	:	22/05/19
Time		15:06
Weather	:	Sunny / Fine / Cloudy / Overcast / Drizzle / Rain / Storm / Hazy
Wind	:	Calm / Light / Breeze / Strong
Temperature	:	29
Humidity	:	High / Moderate / Low

Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:	Asist	tect	NOC
Name:	(sour You wind	S.4. 544	Cices 4 in dees
Title	Acon	TC.	Z-1



Environmental Checklist			tation s*	Remark	
		No			
Fugitive Dust Emission					
Dust control / mitigation measures shall be provided to prevent dust nuisance.	√				
A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allowed.	$\checkmark$				
Water sprays shall be provided and used to dampen materials.					
Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.					
All vehicles shall be restrict to a maximum speed of 10 km per hour.					
Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	1				
The designated site main haul road shall be paved or regular watering.					
Frequent watering of work site shall be at least three times per day.					
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.				······································	
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	$\checkmark$				
All plant and equipment should be well maintained e.g. without black smoke emission.					
Open burning should be prohibited.					
The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	$\checkmark$				
Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	√				
When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.					
The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	$\checkmark$				
The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor and the material landing point is maintained at no more than 1m.	√				
Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non- road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	1				
Noise Impact					
The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	V				
Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction works.					
Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.				· · · · · · · · · · · · · · · · · · ·	
Air compressors and hand held breakers should have noise labels.					
Machines and plants that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	, V				
Noisy equipment and mobile plant shall always be site away from NSRs.	1 J		<u>├</u>		



Environmental Checklist				tation s* N/A	Remark
					]
Water Quality	Vater Quality				
<ul> <li>Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.</li> </ul>				1	
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.					
<ul> <li>Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.</li> </ul>	nels. Earth	V			
<ul> <li>Manholes should be covered and sealed.</li> </ul>		$\checkmark$			
Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.		$\checkmark$			
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.					
A buffer distance of at least 20m shall be maintained between the boundary of the C&DMSF and the seafront.					
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.					
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sp water or protected by other method approved by CEDD.</li> </ul>	prayed with	$\checkmark$			
<ul> <li>Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> </ul>	vegetation	V			
<ul> <li>Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that the are functioning properly at all times.</li> </ul>	e deposited se facilities	V			
<ul> <li>A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed be discharged into storm drains.</li> </ul>	efore being	V			
<ul> <li>The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous n hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.</li> </ul>	naterials or	V			
<ul> <li>Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if us provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.</li> </ul>	e) shall be	V			
<ul> <li>Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.</li> </ul>					
<ul> <li>Oil interceptor shall be provided at work shop.</li> </ul>		$\overline{\mathbf{A}}$			
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.					
The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.	f the tide to	V			
<ul> <li>All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to their bottom openings to prevent leakage of material shall have tight fitting seals to the seals to the</li></ul>	erial during	$\checkmark$			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the tra		Ń			
<ul> <li>Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluen properly collected and treated before disposal.</li> </ul>	nts shall be	$\checkmark$			
<ul> <li>The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the visibility of the barging facilities.</li> </ul>		V			
<ul> <li>Existing silt curtain at the outward side of the basin near the Barging Handling Area (BHA) throughout the period shall be repair and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly such that it can also serve the function of refuse containment boom to confine floating refuse.</li> </ul>	silt curtains	V			
<ul> <li>A waste collection vessel shall be deployed to remove floating debris.</li> </ul>					



Environmental Checklist		emen Stage		Remark
	Yes	No	N/A	
Landscape and Visual				
<ul> <li>The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> </ul>	V			
<ul> <li>The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.</li> </ul>				
<ul> <li>Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> </ul>	$\checkmark$			
<ul> <li>The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	V			
Other Environmental Factors				
<ul> <li>C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> </ul>	V			
<ul> <li>Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnece ssary generation of waste.</li> </ul>		1		
<ul> <li>Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> </ul>				
All generators, fuel and oil storage are within bundle areas.	$\checkmark$			
Oil leakage from machinery, vehicle and plant is prevented.		√		Item 1
The Environmental Permit should be displaced conspicuously on site.				
<ul> <li>Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> </ul>	V			
<ul> <li>To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	V			



## Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Follow up Date
1	Oil stains were observed beside the generator near asphalt deposition platform.	To clean the oil stain properly.	190522_001	Yes	29/05/19

#### Remark

	Name	Title	Signature	Date
Checked by	Frankie Tang	ET Representative	1 And	22 May 2019



## <u>Photo</u>

22.05.2019 15:07 Photo 190522_001 (Near Asphalt Deposition Platform)
--



--



Inspected by	CEDD	Contractor / Sub-Contactor	ET
Signature:	Asoall	Aug	. M. I
Name:	750020 you wind	5. h scm	Mak Lei Mai
Title	Aww	<i>7</i>	E,T



Environmental Checklist		ementa Stages	Remark	
		No		
Fugitive Dust Emission				
<ul> <li>Dust control / mitigation measures shall be provided to prevent dust nuisance.</li> </ul>	V			
A buffer zone of at least 100m shall be maintained between the edge of the stockpiling area and the nearest ASF Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities			 	
<ul> <li>Water sprays shall be provided and used to dampen materials.</li> </ul>	√			
<ul> <li>Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.</li> </ul>				
<ul> <li>All vehicles shall be restrict to a maximum speed of 10 km per hour.</li> </ul>	√		 	
<ul> <li>Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall h and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and t covered by a clean tarpaulin.</li> </ul>				
The designated site main haul road shall be paved or regular watering.	√			
Frequent watering of work site shall be at least three times per day.				
Wheel washing facilities including high-pressure water jet shall be provided at the entrance of work site.	V			
Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	√			
All plant and equipment should be well maintained e.g. without black smoke emission.	√			
Open burning should be prohibited.	√		 · · · · · · · · · · · · · · · · · · ·	
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable water or protected by other method approved by CEDD.</li> </ul>				
<ul> <li>Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by h planting or sealing with shot concrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> </ul>	ydroseeding, vegetation $$			
When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	√			
The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the r	return belt. $$			
The level of stockpiling belt conveyor shall be adjustable such that the vertical distance between the belt conveyor a point is maintained at no more than 1m.	and the material landing $$			
<ul> <li>Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regula road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emiss Cap.311).</li> </ul>				
Noise Impact				
<ul> <li>The approved method of working, equipment and sound-reducing measures (e.g. use of silenced type of eq adapted.</li> </ul>	uipment, etc.) shall be $$			
Only well maintained plant should be operated on-site and plant should be serviced regularly during the construction	n works. 🗸 🗸		 	
Powered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	√		 	
Air compressors and hand held breakers should have noise labels.	1		 	
<ul> <li>Machines and plants that may be in intermittent use should be shut down between work periods or should be throttl</li> </ul>	led down to a minimum. √		 	
<ul> <li>Noisy equipment and mobile plant shall always be site away from NSRs.</li> </ul>	<u>√</u>		 	



Environmental Checklist		ement Stages		Remark
			N/A	
Water Quality				
Drainage system should be adequate and well maintained to prevent flooding and overflow, especially after rain storms.	1			
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.				
Temporary intercepting drains should be used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormwater to the intercepting channels.	V			
Manholes should be covered and sealed.				
<ul> <li>Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.</li> </ul>	$\checkmark$			
A buffer distance of at least 100m shall be maintained between the boundary of the public fill stockpiling area and the sea front.	$\checkmark$			
<ul> <li>A buffer distance of at least 20m shall be maintained between the boundary of the C&amp;DMSF and the seafront.</li> </ul>				
The stormwater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.	$\checkmark$			
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> </ul>	V			
<ul> <li>Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, followed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> </ul>	V			
<ul> <li>Existing and newly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.</li> </ul>		V		Item 2
<ul> <li>A wheel washing bay shall be provided at the site exit and wash-water shall have sand and silt settled out or removed before being discharged into storm drains.</li> </ul>	V			
The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	√			
<ul> <li>Sewage from toilets shall be discharged in to a foul sewer, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.</li> </ul>	√			
Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas.	$\checkmark$			
Oil interceptor shall be provided at work shop.				
Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.				
<ul> <li>The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.</li> </ul>	$\checkmark$			
<ul> <li>All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.</li> </ul>	V			
Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.				
<ul> <li>Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.</li> </ul>	V			
<ul> <li>The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.</li> </ul>	√			
Existing silt curtain at the outward side of the basin near the Barging Handling Area (BHA) throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	V			
A waste collection vessel shall be deployed to remove floating debris.				



Environmental Checklist	Implementation Stages*			Remark
	Yes	No	N/A	
Landscape and Visual				
<ul> <li>The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.</li> </ul>	V			
<ul> <li>The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.</li> </ul>	$\checkmark$			
<ul> <li>Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brown) once completed.</li> </ul>	1			
<ul> <li>The barging point and the C&amp;DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.</li> </ul>	$\checkmark$			
Other Environmental Factors				
<ul> <li>C&amp;D waste sorted from mixed C&amp;D material shall be removed from the temporary buffer storage area on a daily basis and transfer to SENT landfill for disposal.</li> </ul>	V			
Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnece ssary generation of waste.	$\checkmark$			
<ul> <li>Any unused materials or those with remaining functional capacity should be recycled and stored properly.</li> </ul>	$\checkmark$			
All generators, fuel and oil storage are within bundle areas.	$\checkmark$			
Oil leakage from machinery, vehicle and plant is prevented.	$\checkmark$			
The Environmental Permit should be displaced conspicuously on site.	V			
<ul> <li>Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.</li> </ul>	V			
<ul> <li>To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.</li> </ul>	V			



### Summary of the Weekly Site Inspection:

Item	Details of defective works or observations	Proposed Follow Up Action	Photo Ref.	Further Action Required (Yes/No)	Follow up Date
1	Follow up action to item no.1 on 22/05/19,Oil stains near asphalt deposition platform were cleaned		190527_001	No	
2	Silting screen was found performance degradation near Area A5a.	Replace the silting screen properly.	190527_002	Yes	03/06/19


#### Remark

....

	Name	Title	Signature	Date	
Checked by	Frankie Tang	ET Representative		27 May 2019	



### <u>Photo</u>

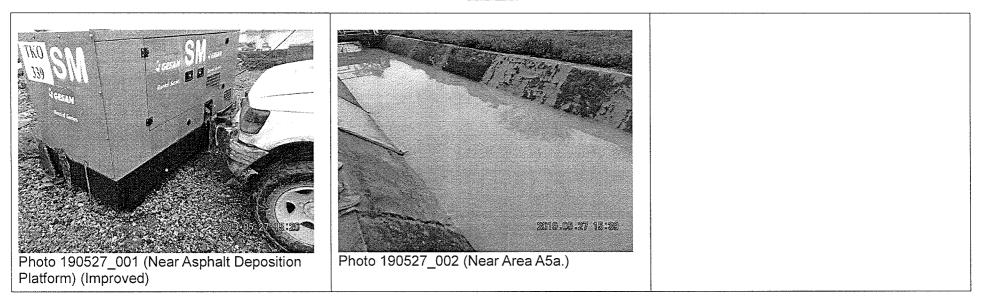



Appendix I

Implementation Schedule of Mitigation Measures



Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O Area 137 Fill Bank Contract No.: CV/2015/07

# Environmental Mitigation Implementation Schedule

		Location	Implementation Status				
	Environmental Protection Measures		Implemented	Partially implemented	Not implemented	Not Applicable	
Aiı	r Quality						
•	Dust control / mitigation measures shall be provided to prevent dust nuisance.	All areas	$\checkmark$				
•	A buffer zone of at least 100m shall be maintained betw een the edge of the stockpiling area and the nearest ASRs at the TKO Industrial Estate. Within the buffer zone, no dusty material shall be stockpiled and no loading / unloading and similar activities should be allow ed.	Northern Site Boundary	$\checkmark$				
•	Water sprays shall be provided and used to dampen materials.	All areas	$\checkmark$				
•	Regular cleaning and watering the site shall be provided to minimize the fugitive dust emissions.	All areas	$\checkmark$				
•	All vehicles shall be restrict to a maximum speed of 10 km per hour.	All areas	$\checkmark$				
•	Any vehicle with open load carrying area used for moving materials which has the potential to create dust shall have properly fitting side and tail boards. Material having the potential to create dust shall not be loaded to a level higher than the side and tail boards, and shall be covered by a clean tarpaulin.	Site Egress	$\checkmark$				
•	The designated site main haul rout shall be paved or regular watering.	All haul roads	$\checkmark$				
•	Frequent watering of work site shall be at least three times per day.	All areas	$\checkmark$				
•	Wheel washing facilities including high pressure water jet shall be provided at the entrance of work site.	Site Egress	$\checkmark$				
•	Every vehicle shall be washed to remove any dusty materials from its body and wheels before leaving the fill bank.	Site Egress	$\checkmark$				
•	The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.	All areas	$\checkmark$				
•	Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, follow ed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.	All areas	$\checkmark$				
•	When fill material is transfer by belt conveyor systems, the conveyors shall be enclosed on top and 2 sides.	C&DMSF	$\checkmark$				
•	The belt scraper shall be equipped with bottom plates or other similar means to prevent falling of material from the return belt.	C&DMFS	$\checkmark$				
•	The level of stockpiling belt conveyor shall be adjustable such that the vertical distance betw een the belt conveyor and the material landing point is maintained at no more than 1m.	C&DMFS	$\checkmark$				
•	All plant and equipment should be w ell maintained e.g. w ithout black smoke emission.	All areas	$\checkmark$				
•	Approval or exemption Non-road Mobile Machinery (NRMM) labels should be painted or securely fixed on regulated machines and non-road vehicles at a conspicuous position according to the Air Pollution Control (Non-road Mobile Machinery) (Emission) Regulation (APCO Cap.311).	All areas	$\checkmark$				
No	ise Impact						
•	Approved method of w orking, equipment and sound-reducing measures (e.g. use of silenced type of equipment, etc.) shall be adapted.	All areas	$\checkmark$				
	Only well maintained plant should be operated on-site and plant should be serviced regularly during the site works.	All areas	$\checkmark$				
•	Pow ered mechanical equipment (PME) should be covered or shielded by appropriate acoustic materials.	All areas					
	Air compressors and hand held breakers should have noise labels.	All areas	$\checkmark$				
•	Machines and plants that may be in intermittent use should be shut dow n between work months or should be throttled dow n to a minimum.	All areas	$\checkmark$				
•	Noisy equipment and mobile plant shall alw ays be site aw ay from NSRs.	All areas	$\checkmark$				



Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O Area 137 Fill Bank	Location	Implementation Status				
Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O Area 137 Fill Bank Contract No.: CV/2015/07 Environmental Protection Measures		Implemented	Partially implemented	Not implemented	Not Applicable	
Water Quality						
Drainage system should be adequate and w ell maintained to prevent flooding and overflow, especially after rain storms.	All areas					
The permanent drainage channels should have sediment basin, traps and baffles and maintain properly.	All areas					
<ul> <li>Temporary intercepting drains should be used at the stockpiling area to divert polluted stormw ater to the intercepting channels.</li> <li>Earth bunds and sand bay barriers shall be used to assist the diversion of polluted stormw ater to the intercepting channels.</li> </ul>	All areas	$\checkmark$				
<ul> <li>Manholes should be covered and sealed.</li> </ul>	All areas					
<ul> <li>Unnecessary water retained in receptacles and standing water should be avoided to prevent mosquito breeding.</li> </ul>	All areas					
• A buffer distance of at least 100m shall be maintained betw een the boundary of the public fill stockpiling area and the sea front.	Public fill stockpiling area	$\checkmark$				
<ul> <li>A buffer distance of at least 20m shall be maintained betw een the boundary of the C&amp;DMSF and the seafront.</li> </ul>	C&DMFS					
<ul> <li>The stormw ater intercepting system shall be effective to collect of runoff and remove suspended solids before discharge.</li> </ul>	All areas					
<ul> <li>The temporary slope surfaces, especially those facing to the north of the site shall be covered with impermeable sheet or sprayed with water or protected by other method approved by CEDD.</li> </ul>	Temporary Slopes	$\checkmark$				
<ul> <li>Final slope surfaces, especially those facing to the north of the site shall be treated by compaction, follow ed by hydroseeding, vegetation planting or sealing with shotconcrete, latex, vinyl, bitumen, or other suitable surface stabilizer approved by CEDD.</li> </ul>	Temporary Slopes	$\checkmark$				
<ul> <li>Existing and new ly constructed Catchpits, sand and silt removal facilities and intercepting channels shall be maintained, and the deposited silt and grit shall be removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.</li> </ul>	All areas					
<ul> <li>A w heel w ashing bay shall be provided at the site exit and w ash-w ater shall have sand and silt settled out or removed before being discharged into storm drains.</li> </ul>	Wheel Washing facility	$\checkmark$				
<ul> <li>The section of construction road between wheel washing bay and the public road shall be paved with concrete, bituminous materials or hardcores to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.</li> </ul>	Wheel Washing facility	$\checkmark$				
<ul> <li>Sew age from toilets shall be discharged in to a foul sew er, or chemical toilets shall be provided. The chemical toilets (if use) shall be provided by a licensed contractor, who will be responsible for disposal and maintenance of these facilities.</li> </ul>	All areas	$\checkmark$				
<ul> <li>Oil intercept in addition of sand / silt removal facilities shall be provided at the car parking areas and w ork shop.</li> </ul>	All areas					
<ul> <li>Tipping halls enclosed with top and 3-side to prevent spillage of material into marine water.</li> </ul>	Barge Handling Area (BHA)	$\checkmark$				
<ul> <li>The barges shall be in right size such that adequate clearance in maintained between the vessels and the seabed at all states of the tide to ensure the undue turbidity is not generated by turbulence from vessel movement or propeller wash.</li> </ul>	Barge Handling Area (BHA)	$\checkmark$				
<ul> <li>All vessels used for transportation of fill material shall have tight fitting seals to their bottom openings to prevent leakage of material during transport.</li> </ul>	Barge Handling Area (BHA)	V				
<ul> <li>Adequate environmental control measures shall be provided to prevent / avoid dropping of fill material into the sea during the transfer.</li> </ul>	seafront	V				
<ul> <li>Barges shall not be filled to a level which may cause the overflow of material during loading or transportation. Barge effluents shall be properly collected and treated before disposal.</li> </ul>	Barge Handling Area (BHA)	$\checkmark$				
<ul> <li>The work activities shall not cause any visible foam, oil, grease, scum, litter or other objectionable matters to be present on the water in the vicinity of the barging facilities.</li> </ul>	seafront	$\checkmark$				
Existing silt curtain at the outward side of the basin near the Barging Handling Area throughout the period shall be repair, maintain and service when there is public fill intake by barges to the Fill Bank in accordance with PS Clause 1.68. The total length of the silt curtains shall not be less than 160m, and a gap of about 80m shall be left open for access of barges. The silt curtain shall be properly maintained such that it can also serve the function of refuse containment boom to confine floating refuse.	Along the	V				
<ul> <li>A waste collection vessel shall be deployed to remove floating debris.</li> </ul>	Along the seafront	$\checkmark$				



Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O Area 137 Fill Bank Contract No.: CV/2015/07


	Location	Implementation Status				
Environmental Protection Measures		Implemented	Partially implemented	Not implemented	Not Applicable	
Landscape and Visual						
• The design of the fill bank and platform heights adopted should allow the fill bank to fit into the general topography of the surrounding land. Straight edged slopes should be avoided.	All areas	$\checkmark$				
• The maximum stockpiling height at the fill bank shall be limited to a maximum of +35.2mPD.	Completed slopes	$\checkmark$				
• Surface of outer slopes of the fill bank shall preferably be hydroseeded or covered with geo-textile matting of appropriate colour (e.g. dark green / brow n) once completed.	Site boundary	$\checkmark$				
• The barging point and the C&DMSF at the fill bank shall not be in operation from 07:00 pm to 08:00 am daily to avoid potential visual impact from glare.	All areas	$\checkmark$				
Other Environmental Factors						
C&D w aste sorted from mixed C&D material shall be transfer to SENT landfill for disposal.	All areas	$\checkmark$				
Plan and stock construction materials carefully to minimise generation of waste.	All areas	$\checkmark$				
Any unused materials or those with remaining functional capacity should be recycled.	All areas	$\checkmark$				
All generators, fuel and oil storage are within bunded areas.	All areas					
Oil leakage from machinery, vehicle and plant is prevented.	All areas		$\checkmark$			
The Environmental Permit should be displaced conspicuously on site.	All areas					
• Good site practices should be adopted to clean the rubbish and litter on a regular basis so as to prevent the rubbish and litter from dropping into the nearby environment.	All areas	$\checkmark$				
• To encourage collection of aluminium cans by individual collectors, separate labelled bins should be provided to segregate this waste from other general refuse generated by the workforce.	All areas	$\checkmark$				



Appendix J

Site General Layout plan



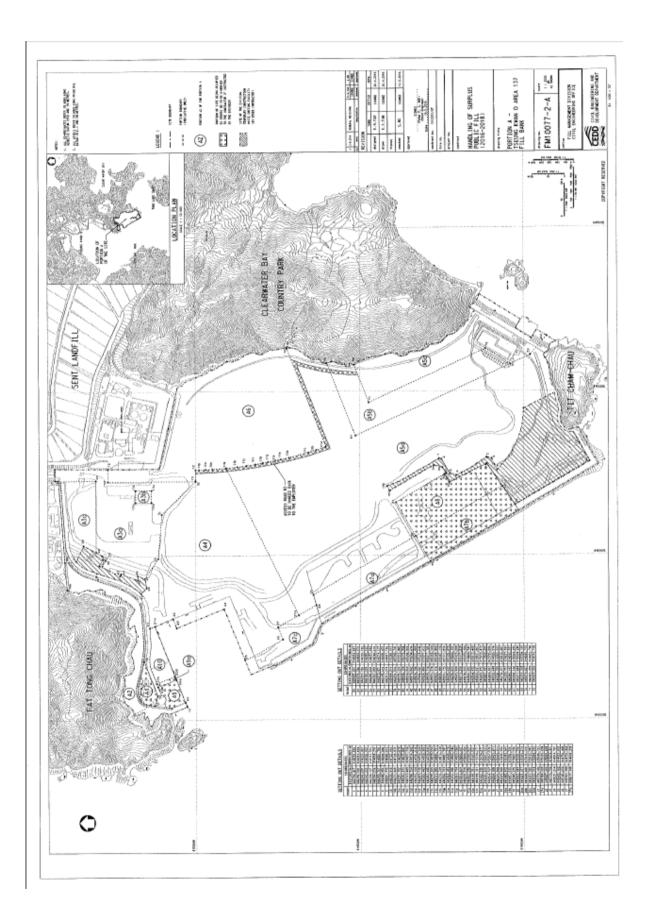



Appendix K

Monitoring Schedule for the Coming Month



Contract No. CV/2015/07 Handling of Surplus Public Fill (2016-2018)

### Tseung Kwan O Area 137

Time Schedule for Impact Water Quality Monitoring (WQM), Impact Air Monitoring (1-hr TSP, 24-hr TSP and 24-hr RSP), Weekly Site Inspection (Weekly SI) and Impact Noise Monitoring (NM)

Sun	Mon	Tue	Wed	Thu	Fri	Sat
26	27 <u>1-hr TSPX1</u> <u>WQM</u> Mid-ebb (08:28-10:28) Mid-flood (12:49-14:49)	28 <u>24 hr TSP</u> <u>24-hr RSP</u>	29 <u>1-hr TSPX2</u> <u>Weekly SI (pm)</u> <u>WQM</u> Mid-ebb (08:26-10:26) Mid-flood (13:23-15:23)	30	31 <u>1-hr TSPX1</u> <u>WQM</u> Mid-ebb (09:37-11:37) Mid-flood (15:34-17:34)	1/6
2	3 24 hr TSP 24-hr RSP <u>NM</u> WQM Mid-ebb (10:15-12:15) Mid-flood (15:37-17:37)	4	5 <u>1-hr TSPX3</u> <u>Weekly SI (pm)</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (12:38-14:38)	6	7	8 <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (15:14-17:14)
9 24 hr TSP 24-hr RSP	10 <u>1-hr TSPX1</u> <u>WQM</u> Mid-flood (10:13-12:13) Mid-ebb (15:05-17:05)	11	12 <u>1-hr TSPX1</u> <u>Weekly SI (pm)</u> <u>WQM</u> Mid-ebb (08:00-10:00) Mid-flood (13:14-15:14)	13	14 <u>1-hr TSPX1</u> <u>WQM</u> Mid-ebb (09:13-11:13) Mid-flood (14:37-16:37)	15 <u>24 hr TSP</u> <u>24-hr RSP</u>
16	17 <u>1-hr TSPX2</u> <u>WQM</u> Mid-ebb (10:17-12:17) Mid-flood (15:45-17:45)	18	19 <u>1-hr TSPX1</u> <u>Weekly SI (pm)</u> <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (13:36-15:36)	20	21 24 hr TSP 24-hr RSP WQM Mid-flood (08:00-10:00) Mid-ebb (13:50-15:50)	22
23	24 <u>1-hr TSPX2</u> <u>WQM</u> Mid-flood (08:31-10:31) Mid-ebb (15:34-17:34)	25	26 <u>1-hr TSPX1</u> <u>Weekly SI (pm)</u> <u>WQM</u> Mid-flood (09:27-11:27) Mid-ebb (14:57-16:57)	27 <u>24 hr TSP</u> 24-hr RSP	28 <u>1-hr TSPX3</u> <u>WQM</u> Mid-ebb (08:20-10:20) Mid-flood (14:07-16:07)	29
30	1/7	2 <u>WQM</u> Mid-ebb (10:51-12:51) Mid-flood (15:28-17:28)	3 <u>24 hr TSP</u> <u>24-hr RSP</u> Weekly SI (pm)	4 <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (13:26-15:26)	5 <u>1-hr TSPX2</u>	6 <u>WQM</u> Mid-flood (08:00-10:00) Mid-ebb (14:07-16:07)

### June 2019

Remark: Due to the tidal period in holiday, 07 June 2019 water monitoring was cancelled.



Appendix L

**Complaint Log** 



# **Complaint Logs**

Log Ref.	Location	Received Date	Details of Complaint	Investigation / Mitigation Action	Status
001	Barge handling area (BHA) at Tseung Kwan O 137	15 May 2017	One complaint received on 15 May 2017, which was forwarded to ET on 11 August 2017, from CEDD (Complaint NCF-N08/RE/00014875-17 Sent By CSO[RN]3 [CASE#2- 3943858817 Int.Comm. – WS170513A57354] against illegal dumping at sea without permit in TKO137 fill bank.	<ul> <li>Refer to the ET site investigation on 14 August 2017, the contractor clarified that the contractor conducted vessel loading test at Tseung Kwan O 137 Fill bank on 13 May 2017 and the material was then unloaded from the vessels.</li> <li>Follow up action to complaint by ET and contractor: Contractor under the valid dumping permit to dump fill materials and the site works shall be complied with the relevant environmental protection and pollution control ordinances.</li> <li>ET reminded contractor that the dump fill material under the valid dumping permit should be checked and confirmed. In addition, record should be kept for ET reference.</li> <li>Details of Action(s) Taken by the Contactor:</li> <li>The contractor started to dump fill materials from 19 May 2017 after receiving the valid dumping permit.</li> <li>The contractor dump fill materials were followed by the valid dumping permit and the permit was kept apply every three month</li> <li>The contractor kept the permit for ET reference.</li> </ul>	Closed
002	Tseung Kwan O 137 Fill Bank	12 Oct 2017	One complaint received on 12 October 2017, which was forwarded to ET on 18 October 2017, from public against dust emission at the fill bank and discharge of muddy water to the seafront.	<ul> <li>Refer to the ET weekly site inspection on 18 October 2017, no defective observation related to dust emission and discharge of water was recorded during the investigation.</li> <li>Details of Action(s) Taken by the Contactor: <ul> <li>Regular water spraying by water lorries is provided for dust suppression inside the Fill Bank;</li> <li>Mist spraying systems at the site entrance are operated properly;</li> <li>Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;</li> <li>All dusty material is sprayed with water prior to loading, unloading or transfer so as to maintain the material wet;</li> <li>Site vehicle for transporting materials are covered properly by using clean tarpaulin sheets;</li> <li>Regular cleaning at the site haul road is provided to minimize the fugitive dust emission;</li> <li>Silt curtains are provided at the outward side of the basin near the Fill Bank;</li> <li>Drainage systems are adequate and maintained to prevent flooding and overflow;</li> <li>Catchpits, sand and silt removal facilities and intercepting channels are maintained and functioning properly.</li> </ul> </li> </ul>	Closed

## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

	1			\ \	
003	Tseung Kwan O 137 Fill Bank	09 April 2018	One complaint received on 09 April 2018, which was forwarded to ET on 18 April 2018, from public against the rocks and debris deposited on the road surface along Wan Po Road near TKO137 Fill Bank. The complainant complained that waste generated caused an environmental nuisance.	<ul> <li>Refer to the ET site investigation on 20 April 2018, the condition of Wan Po Road near TKO137 Fill Bank was found satisfactory. (Photos on ET follow-up investigation at TKO137 Fill Bank on 20 April 2018).</li> <li>Details of Action(s) Taken by the Contactor: <ul> <li>Regular cleaning on Wan Po Road and the access road at the site exit by haul road cleaning team to remove mud and gravel is arranged eight times per month;</li> <li>Regular water spraying by water lorries is provided for road cleaning at Wan Po Road;</li> <li>Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;</li> <li>Site vehicles for transporting materials are covered properly by using clean tarpaulin sheets;</li> <li>Regular cleaning at the site haul road is provided.</li> </ul> </li> </ul>	Closed
004	Tseung Kwan O 137 Fill Bank	13 January 2019	One complaint received on 13 January 2019, which was forwarded to ET on 16 January 2019, from EPD (NCF- N08/RE/00001348-19) against 將 軍澳 137 堆填區內,缸車池污 水,不經處理,直接排到河 道,河道係直接流出大海,極 度嚴重影響周遭環境生態,污 染程度極為嚴重,促請政府有 關部門嚴正跟進!	<ul> <li>After received the details of the complaint from the Contractor on 16 January 2019, ET have performed a site investigation on 21 January 2019 to investigate this event. During the site inspection, no muddy water was observed discharged from the Fill Bank to nearby environment.</li> <li>Besides, refer to the marine water monitoring results during that period, no exceedance was recorded on Turbidity and Suspended Solids. This reflects that this occurrence did not affect the condition of marine water near the TKO137Fill Bank.</li> <li>Details of Action(s) Taken by the Contactor: <ul> <li>Drainage system were adequate and well maintained to prevent flooding and overflow;</li> <li>Sand and silt removal facilities, e.g. silting screen, were provided before the discharge point;</li> <li>Temporary intercepting drains were used at the stockpiling area to divert polluted stormwater to the intercepting channels. Earth bunds and sand bay barriers were used to assist the diversion of polluted stormwater to the intercepting channels were maintained, and the deposited silt and grit were removed weekly and on a need basis especially at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times;</li> </ul></li></ul>	Closed

## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

005	Tseung Kwan O 137 Fill Bank	14 May 2019	One complaint received on 14 May 2019, which was forwarded to ET on 14 May 2019, from public against 投 訴將軍澳第 137 區填料庫,有 車出入沒有灑水傳出大量沙 塵,破壞環境,帶出大量沙泥 到馬路,造成污染及嚴重滋 擾,要求跟進。要求改善,停 止滋擾	road cleaning team to remove mud and gravel is arranged eight times per month;	Closed
-----	-----------------------------------	----------------	--	--	--------



ETS-Testconsult Ltd – Environmental Team (ET)
Complaint Investigation Report

### Contract No.CV/2015/07 Handling of Surplus Public Fill (2016-2018) – Tseung Kwan O 137 Fill Bank

14 May 2019

Details of the Complaint

Log No. : 005

Date

15 May 2019

Date and Time of Complaint

Location

Tseung Kwan O 137 Fill Bank

#### Circumstances:

One complaint received on 14 May 2019, which was forwarded to ET on 14 May 2019, from public against 投訴將軍澳第 137 區填料庫,有車出入沒有灑水傳出大量沙塵,破壞環境,帶出大量沙泥到馬路,造成污染及嚴重滋擾,要求跟進。 要求改善,停止滋擾。

#### Follow action(s)

Follow up by

#### Details of Follow up action(s)

ET

Refer to the ET site investigation on 15 May 2019, the condition of Wan Po Road near TKO137 Fill Bank was found satisfactory. (Photos on ET follow-up investigation at TKO137 Fill Bank on 15 May 2019).

However, the Contractor was still reminded to provide sufficient frequencies of road cleaning. The Contractor replied that additional mitigation measures to clean-up the wheels of site truck will be implemented and additional road sweeper and water spraying will be arranged if necessary.

#### Details of Action(s) Taken by the Contactor

- 1. Regular cleaning on Wan Po Road and the access road at the site exit by haul road cleaning team to remove mud and gravel is arranged eight times per month;
- 2. Regular water spraying by water lorries is provided for road cleaning at Wan Po Road;
- 3. Site vehicles are washed to remove any dusty materials from their bodies and wheels by using high pressure water jet manually at the entrance of work site before leaving;
- 4. Site vehicles for transporting materials are covered properly by using clean tarpaulin sheets;
- 5. Regular cleaning at the site haul road is provided.

#### Conclusion


Due to the complaint, the Contractor has implemented control measures to reduce waste impact to the environment but some improvement should be carried out. The Contractor will take more effort on cleaning of site haul road and public road, and also site truck before leaving the site.

Prepared by:	Frankie Tang	Signature:	And the
Designation:	ET Representative	Date:	15 May 2019
Checked by:	C. L. Lau	Signature:	27
Designation:	Environmental Team Leader	Date:	45 May 2019



# Photos during ET site investigation at TKO137 on 15 May 2019


## Wheel Washing Bay

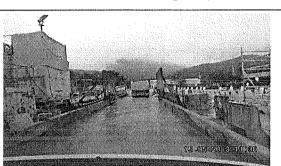

**Site Entrance** 




Wan Po Road

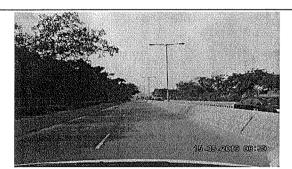



Figures

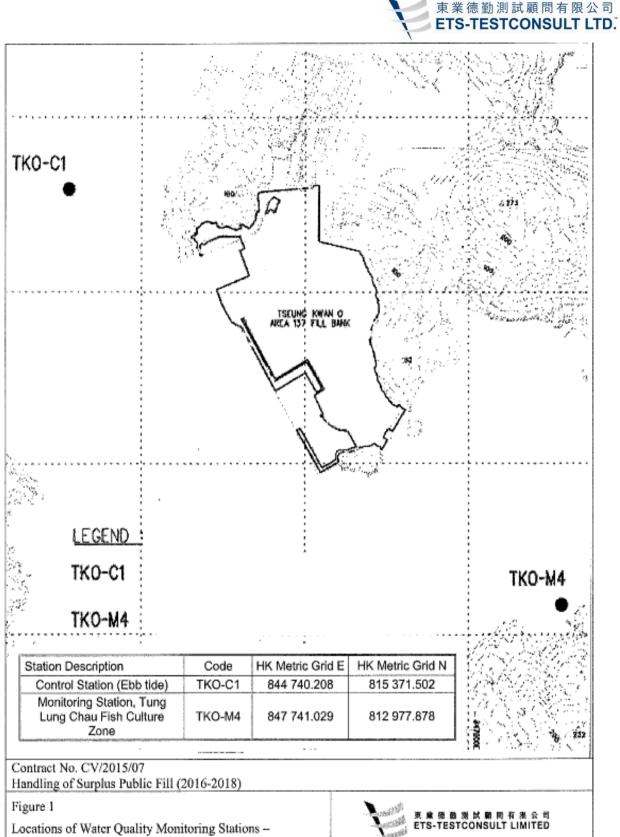

Tseung Kwan O Area 137 Fill Bank

