


MTR Corporation Limited

South Island Line (East)

Monthly EM&A Report No. 42

January 2015


Verified by:

  
\_\_\_\_\_

Thomas Chan

Independent Environmental Checker

Date:

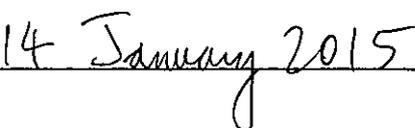  
\_\_\_\_\_


MTR Corporation Limited

South Island Line (East)

Monthly EM&A Report No. 42

January 2015

Certified by:

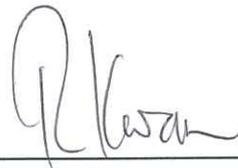

---

Richard Kwan

Environmental Team Leader

Date: **14 JAN 2015**

---

## EXECUTIVE SUMMARY

With the main civil works contracts of the South Island Line (East) (SIL(E)) Project awarded in May 2011, the commencement date of construction of the Project was on 25 June 2011. The Environmental Monitoring and Audit (EM&A) programme of the Project also commenced on 25 June 2011. This is the forty-second Monthly EM&A Report for SIL(E) Project. The Report presents the results of EM&A works undertaken during the period of 1 to 31 December 2014. The major construction activities in the reporting period included excavation, slope stabilization works, shaft excavations, tunnel excavation as well as construction of stations and depot. Operation of magazine at Chung Hom Shan has been terminated in October 2014.

Impact monitoring for air quality and noise were conducted in the reporting period. No exceedance was found and there was no breach of Action / Limit Levels for air quality and noise monitoring. Impact water quality monitoring was undertaken at Telegraph Bay in the reporting period. Exceedances in SS and Turbidity against Action/ Limit Levels were recorded and the exceedances were considered not related to the project works.

No complaint referred by EPD was received in the reporting month.

No notification of summon or prosecution related to the environmental issue was received in the reporting period.

Regular site inspections were conducted by the Environmental Team (ET) to check the implementation of environmental mitigation measures. No non-conformance to the environmental requirements was identified in the reporting period.

Future key issues envisaged in the coming month include noise and dust emission from site works. The ET will continue the implementation of the EM&A programme in accordance to the EM&A Manual.

## **TABLE OF CONTENTS**

### EXECUTIVE SUMMARY

1. INTRODUCTION
  - 1.1 Project Background
  - 1.2 Project Programme
  - 1.3 Coverage of EM&A Report
2. PROJECT INFORMATION
  - 2.1 Project Organization and Management Structure
  - 2.2 Construction Activities in the Reporting Month
  - 2.3 Construction Activities for the Coming Month
  - 2.4 Project Areas and Environmental Monitoring Locations
  - 2.5 Summary of EM&A Requirements
3. IMPACT MONITORING
  - 3.1 Air Quality
  - 3.2 Noise
  - 3.3 Water Quality
  - 3.4 Action taken in Event of Exceedance
4. LANDSCAPE AND VISUAL
  - 4.1 EM&A Requirements
  - 4.2 Site Audit Results
5. ECOLOGY
  - 5.1 EM&A Requirements
  - 5.2 Site Audit Results
6. WASTE MANAGEMENT
7. RECORD OF ENVIRONMENTAL COMPLAINTS
8. RECORD OF NON-COMPLIANCES
9. RECORD OF NOTIFICATIONS OF SUMMONS AND PROSECUTIONS
10. STATUS OF STATUTORY SUBMISSIONS
  - 10.1 Submissions required under Environmental Permit
  - 10.2 Statutory Permits and Licenses
11. SITE INSPECTIONS
  - 11.1 Implementation of Environmental Mitigation Measures
  - 11.2 Observations
  - 11.3 Solid and Liquid Waste Management Status
  - 11.4 Other Notable Events
12. FUTURE KEY ISSUES
13. CONCLUSIONS

## **List of Tables**

Table 1      Summary of impact dust and noise monitoring stations

Table 2      Summary of impact water quality monitoring stations

## **List of Figures**

Figures 1 to 2   Works Areas of the Project

Figures 3 to 6   Location of Construction Air Quality Monitoring Stations

Figures 7 to 8   Location of Construction Noise Monitoring Stations

Figures 9      Air Quality and Noise Monitoring Locations for Telegraph Bay Barging Point

Figures 10     Water Quality Monitoring Locations for Telegraph Bay Barging Point

## **List of Appendices**

Appendix A1   Project Organization

Appendix A2   Contact List of Key Personnel of the Project

Appendix B1   Action and Limit Levels for Construction Noise and Air Quality

Appendix B2   Action and Limit Levels for Water Quality

Appendix C    Calibration Details

Appendix D   Graphical Plots of Air Quality, Noise & Water Quality Monitoring and Monitoring Results for Water Quality

Appendix E   Review of Exceedance in Environmental Monitoring

Appendix F   Implementation of Environmental Mitigation Measures

# 1. INTRODUCTION

## 1.1 Project Background

The South Island Line (East) (SIL(E)) of 7.0km approximately is a new medium capacity railway with stations at South Horizons (SOH), Lei Tung (LET), Wong Chuk Hang (WCH), Ocean Park (OCP) and Admiralty (ADM), comprising underground and elevated structures. A depot is required at Wong Chuk Hang to provide maintenance support for the SIL(E).

## 1.2 Project Programme

Main civil works contracts of the SIL(E) were awarded in May 2011. The commencement date of construction of the Project was on 25 June 2011. The construction of the Project is expected to complete in 2016.

## 1.3 Coverage of EM&A Report

The Environmental Monitoring and Audit (EM&A) programme of the Project commenced on 25 June 2011. This is the forty-second Monthly Environmental Monitoring and Audit (EM&A) Report for the Project. The Report presents the results of EM&A undertaken during the period of 1 to 31 December 2014.

# 2. PROJECT INFORMATION

## 2.1 Project Organization and Management Structure

The project organization is shown in [Appendix A1](#). Contacts of key personnel of the Project are shown in [Appendix A2](#).

## 2.2 Construction Activities in the Reporting Month

Major construction activities carried out by the respective SIL(E) civil works contractors during the reporting period include:

<b>Contract No. 901</b>	
<b>Site</b>	<b>Construction Activities</b>
Harcourt Garden	<ul style="list-style-type: none"><li>- Excavation, blasting works at cavern, tunnels and station box</li><li>- Construction works at station box, cavern and tunnels</li><li>- Underpinning works at station box</li><li>- Dismantling of skip hoist</li><li>- ABWF works at station box</li><li>- Vent shaft modification work</li><li>- A&amp;A works at Admiralty Station</li></ul>

**Contract No. 902**

Site	Construction Activities
Hong Kong Park Ventilation Shaft	- Construction of shaft
Nam Fung Portal	- Construction for transition box - Tunnel excavation by drill and blast - Construction of ventilation building
Chung Hom Shan Magazine	- Handover to LandsD completed
Telegraph Bay Barging Point	- Reinstatement works

**Contract No. 903**

Site	Construction Activities
Zone B (Ex-Canadian Site to OCP Station)	- Reinstatement works in Zone B (B2-B6) - Noise Barrier Installation in Zone B (B4)
OCP Station	- Glazed panels of the glass façade - Door frame installation - Ceiling Installation - Mosaic tiles on wall and columns - Installation of glass balustrade - Removal of concrete bases of tower cranes -
Zone C (OCP Station to WCH Station)	- PSR and HYR East Road and Drainage works - Bitumen paving for road reinstatement in Zone C (C2-C3) - Carriage works at OCP roundabout -
WCH Station	- Installation of Glass balustrade - Construction of openable window at concourse level - Entrance A-ABWF works - Entrance B Footbridge construction
Zone D (WCH Station to WCH nullah) and External Works	- Pedestrian Link Bridge Installation (D17 and Kun Hoi Path) - HYR/NLS Road and Drainage works - Reinstatement Works
Zone E (ACB)	- Remaining works of Pavement

**Contract No. 904**

Site	Construction Activities
Ex-Harbour Mission School	- Backfilling - Tunnel box construction - Retaining wall construction - Drainage work - TTM work
Lee Wing Street	- Construction of main tunnel - Construction of ventilation building
LET Station Entrance A	- Construction of adit - Construction of station - Backfilling
LET Station Entrance B	- Shaft and adit excavation and construction
South Horizons	- Station structure construction - Landscape works at EPIW Footbridge to Ap Lei Chau Estate

Site	Construction Activities
South Horizons Plant Building	- Slope protection - Plant building structure construction
Project site office at Ap Lei Chau Bridge Playground	- Handover to LCSD completed
Lee Wing Street Barging Point	- Reinstatement works

**Contract No. 908**

Site	Construction Activities
WCH Depot	- Architectural builders works and finishes - Road Works

**2.3 Construction Activities for the Coming Month**

The scheduled major construction activities in the next reporting month are as follows:

**Contract No. 901**

Site	Construction Activities
Harcourt Garden	- Excavation, blasting works at cavern, tunnels and station box - Construction works at station box, cavern and tunnels - Underpinning works at station box - Dismantling of skip hoist - ABWF works at station box - Vent shaft modification work - A&A works at Admiralty Station

**Contract No. 902**

Site	Construction Activities
Hong Kong Park Ventilation Shaft	- Construction of shaft - Dismantling and removal of blast cover
Nam Fung Portal	- Construction for transition box - Tunnel excavation by drill and blast - Construction of ventilation building - Reinstatement works
Chung Hom Shan Magazine	- Handover to LandsD completed
Telegraph Bay Barging Point	- Reinstatement works

**Contract No. 903**

Site	Construction Activities
Zone B (Ex-Canadian Site to OCP Station)	- Reinstatement works in Zone B (B2-B6) - Utilities works in Zone B (B4) - Remaining works of Noise Barrier Installation - Reinstatement of profile barrier
OCP Station	- Glazed panels of the glass façade - Ceiling Installation - Mosaic tiles on wall and columns - Construction of footbridge to Ocean Park - Removal of concrete bases of tower cranes

Zone C (OCP Station to WCH Station)	<ul style="list-style-type: none"> <li>- PSR and HYR East Road and Drainage works</li> <li>- Bitumen paving for road reinstatement in Zone C (C2-C3)</li> <li>- Carriage works at OCP roundabout</li> </ul>
WCH Station	<ul style="list-style-type: none"> <li>- Ceiling Installation</li> <li>- Steel work &amp; glazed panel for external façade</li> <li>- Door frame installation</li> <li>- Entrance A-ABWF works</li> <li>- Entrance B Footbridge construction</li> <li>- Removal of Vehicular Portal for Wong Chuk Hang Footbridge across Wong Chuk Hang Road</li> </ul>
Zone D (WCH Station to WCH nullah) and Exteranal Works	<ul style="list-style-type: none"> <li>- Pedestrian Link Bridge Installation (D17 and Kun Hoi Path)</li> <li>- HYR/NLS Road and Drainage works</li> <li>- Noise Barrier Installation</li> <li>- Reinstatement Works</li> </ul>
Zone E (ACB)	<ul style="list-style-type: none"> <li>- Remaining works of Pavement</li> </ul>

#### **Contract No. 904**

Site	Construction Activities
Ex-Harbour Mission School	<ul style="list-style-type: none"> <li>- Backfilling</li> <li>- Tunnel box construction</li> <li>- Retaining wall construction</li> <li>- Drainage work</li> <li>- TTM work</li> </ul>
Lee Wing Street	<ul style="list-style-type: none"> <li>- Construction of main tunnel</li> <li>- Construction of ventilation building</li> </ul>
LET Station Entrance A	<ul style="list-style-type: none"> <li>- Construction of adit</li> <li>- Construction of station</li> </ul>
LET Station Entrance B	<ul style="list-style-type: none"> <li>- Shaft and adit excavation and construction</li> </ul>
South Horizons	<ul style="list-style-type: none"> <li>- Station structure construction</li> <li>- Landscape works at EPIW Footbridge to Ap Lei Chau Estate and handover completed</li> </ul>
South Horizons Plant Building	<ul style="list-style-type: none"> <li>- Slope protection</li> <li>- Plant building structure construction</li> </ul>
Lee Wing Street Barging Point	<ul style="list-style-type: none"> <li>- Reinstatement works</li> </ul>

#### **Contract No. 908**

Site	Construction Activities
WCH Depot	<ul style="list-style-type: none"> <li>- Architectural builders works and finishes</li> <li>- Road Works</li> </ul>

## **2.4 Project Areas and Environmental Monitoring Locations**

The works areas of the Project are shown in **Figures 1 and 2**. Impact dust and noise monitoring has been conducted at designated monitoring locations during operation of the Telegraph Bay barging point in accordance with the Construction and Demolitions Materials Management Plan (C&DMMP) approved under EP. Operation of barging point has been terminated by 30 September 2014. Reinstatement of barging point commenced in October 2014 while marine-based demolition works started on 14 November 2014. The impact dust and noise monitoring during the restatement works at the barging point at Telegraph Bay will be carried out in accordance with the environmental review report submitted for variation to SIL(E) Environmental Permit EP-407/2010 in November 2011.

Regular site audits will continue to be carried out in parallel to ensure that the recommended mitigation measures are properly implemented. Marine water quality monitoring has been conducted during the period of marine-based demolition in accordance with Silt Curtain Plan for Marine-based Decommissioning of Temporary Pier at Telegraph Bay submitted under the EP.

The locations of environmental monitoring stations are shown in **Figures 3 to 10**. Tables 1 and 2 below shows the details of the active monitoring stations as reported in Sections 3.1 to 3.3 below.

**Table 1 Summary of impact dust and noise monitoring stations**

ID	Monitoring Station
<b>Dust</b>	
CD1	Wong Chuk Hang San Wai
CD2	Police College – Police Quarters
CD3	San Wui Commercial Society of HK Chan Pak Sha School
CD4	Shan On House
CD5*	South Horizons Phase IV – Block 25
DTB1	Site boundary of Telegraph Bay barging point
<b>Noise</b>	
CN1	San Wui Commercial Society of HK Chan Pak Sha School (Educational Institution)
CN2	Holy Spirit Seminary (Education Institution)
CN3*	Shun Fung Building (Residential)
CN4*	South Horizons Phase IV – Block 25 Dover Court (Residential)
CN5*	TWGHs Jockey Club Rehabilitation Complex Block A (Convalescent Home)
NTB1	Outside Aegean Terrace

\* Location updated due to site access problem, or as per the agreement with the premises landlord, and agreed with EPD

**Table 2 Summary of impact marine water quality monitoring stations**

Monitoring Stations	Coordinates	
	Easting	Northing
<b><i>Control Stations</i></b>		
CE (Ebb)	830026	814956
CF (Flood)	831778	812420
<b><i>Impact Stations</i></b>		
I1	831088	813654
I2	831105	813582
Intake A	831610	812931
Intake B	830606	814583

## 2.5 Summary of EM&A Requirements

The EM&A programme as specified in the EM&A Manual has been implemented during the construction stage.

In the reporting period, impact monitoring of LAeq, 30min noise levels was carried out at the monitoring locations as shown in Table 1 once a week. Also, 24-hour TSP monitoring was conducted at the monitoring locations as shown in Table 1 once a week. Impact water quality monitoring at Telegraph Bay was also undertaken at the monitoring locations as shown in Table 2 three working days per week at mid-ebb and mid-flood tides.

Action and Limit Levels for construction noise and air quality as well as water quality are shown in **Appendices B1 and B2** respectively. Should non-compliance of the criteria occurs, action in accordance with the respective Event and Action Plans for construction noise, air quality and water quality in the EM&A Manual / Updated EM&A Manual / Silt Curtain Plan should be carried out.

Monthly monitoring of the ardeid night roost location beside Wong Chuk Hang Nullah by qualified ecologist was also conducted.

In addition, regular site inspection to active works areas was carried out. The areas of inspection included the pollution control and mitigation measures within the site. Waste management and landscape and visual aspects were covered.

## 3. IMPACT MONITORING

### 3.1 Air Quality

#### *Monitoring Methodology*

24-hour TSP samples were collected by High Volume Sampler (Graseby-Andersen) following United States Environmental Protection Agency regulations. The sampling procedure follows to that described in the App. B of Pt 50 in 40CFR Ch.1 (U.S. Environmental Protection Agency). TSP is sampled by drawing air through a conditioned, pre-weighed filter paper inside the high volume sampler at a controlled rate. After 24-hour sampling, the filter paper with retained particles is collected and returned to the laboratory for drying in a desiccators followed by weighing. TSP levels are calculated from the ratio of the mass of particulate retained on the filter paper to the total volume of air sampled.

The samplers have been properly maintained. Prior to dust monitoring commencing, appropriate checks have been made to ensure that all equipment and necessary power supply are in good working condition.

#### *Calibration Requirements*

The flow rate of the high volume sampler with mass flow controller is calibrated using an orifice calibrator. Initial calibration (five points) is conducted upon installation and prior to commissioning. Calibration will be carried out every six months. The calibration records are shown in **Appendix C**.

### Monitoring Results

To examine the construction dust levels, 24-hour TSP monitoring was undertaken at the monitoring locations as shown in Table 1 according to the EM&A Manual.

Monitoring results are presented in the following table (see **Appendix D** for graphical plots). The 24-hour TSP levels were within the Action Level. No exceedance was found. This indicates that the construction activities did not have a noticeable adverse effect on the general air quality of the project areas. However, excavation and reinstatement works by other Project were observed in the vicinity of monitoring station DTB1 at Telegraph Bay barging point during the reporting month, which have generated fugitive dust emitting to the local environment. The dust suppression measures, such as water spraying on the haul road and tipping hall, for the barging point operation were ongoing.

Date	TSP ( $\mu\text{g}/\text{m}^3$ )	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )	Compliance (Yes/No)	Weather Condition
<b>CD1 Wong Chuk Hang San Wai</b>					
3-Dec	71.4	173	260	Yes	Cloudy
10-Dec	83.2	173	260	Yes	Fine
17-Dec	85.3	173	260	Yes	Fine
24-Dec	75.2	173	260	Yes	Fine
31-Dec	89.4	173	260	Yes	Fine
<b>CD2 Police College – Police Quarters</b>					
1-Dec	80.1	184	260	Yes	Fine
8-Dec	83.2	184	260	Yes	Fine
15-Dec	136.1	184	260	Yes	Fine
22-Dec	130.5	184	260	Yes	Fine
29-Dec	82.5	184	260	Yes	Fine
<b>CD3 San Wui Commercial Society of HK Chan Pak Sha School</b>					
1-Dec	48.1	169	260	Yes	Fine
8-Dec	71.5	169	260	Yes	Fine
15-Dec	113.6	169	260	Yes	Fine
22-Dec	75.0	169	260	Yes	Fine
29-Dec	51.4	169	260	Yes	Fine
<b>CD4 Shan On House</b>					
4-Dec	38.6	176	260	Yes	Cloudy
11-Dec	104.8	176	260	Yes	Fine
16-Dec	98.4	176	260	Yes	Fine
24-Dec	53.4	176	260	Yes	Fine
31-Dec	64.5	176	260	Yes	Fine
<b>CD5 South Horizons Phase IV – Block 25</b>					
4-Dec	32.8	169	260	Yes	Cloudy
11-Dec	101.5	169	260	Yes	Fine
16-Dec	86.7	169	260	Yes	Fine
24-Dec	55.5	169	260	Yes	Fine
31-Dec	75.6	169	260	Yes	Fine
<b>DTB1 Site boundary of Telegraph Bay barging point</b>					
4-Dec	42.1	156	260	Yes	Cloudy
11-Dec	122.1	156	260	Yes	Fine
16-Dec	112.9	156	260	Yes	Fine
24-Dec	76.5	156	260	Yes	Fine
31-Dec	85.7	156	260	Yes	Fine

Note: Please refer to [Figures 3 to 6 and 9](#) for the location of construction air quality monitoring stations

## 3.2 Noise

### *Monitoring Methodology*

Monitoring was conducted using B&K sound analysis equipment – B&K SLM 2250. Microphone was extended 1 meter from building facades and oriented towards the works area.

### *Calibration Requirements*

B&K 2250 sound level meters and B&K 4231 calibrators which complied with the International Electrotechnical Commission Publication 651:1979 (Type 1) and 804:1985 (Type 1), specification as referred to in the Technical Memoranda to the NCO were used for the impact monitoring. The sound level meters and calibrators are verified by the certified laboratory or manufacturer once every two years and once every year respectively to ensure they perform to the same level of accuracy as stated in the manufacturer's specifications. The calibration records are shown in **Appendix C**.

Immediately prior to and following each set of measurements at any NSR, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. If the calibration levels before and after the measurement differs by more than 1.0dB, the measurement shall be repeated to obtain a reliable result (note: maximum deviation during this initial baseline monitoring period was 0.3dB). Periods of prolonged or repeated overloading of the sound level meter detector were avoided by setting the meter with adequate headroom prior to commencing measurements. Measurements were recorded to the nearest 0.1 dB, with values of 0.05 being rounded up.

### *Monitoring Results*

Impact monitoring of LAeq, 30min noise levels was undertaken to measure construction noise levels in accordance with the Updated EM&A Manual at the monitoring locations as shown in Table 1. The monitoring was conducted during the course of construction works, please refer to S2.2 for major construction activities of the respective SIL(E) civil works contracts in the reporting month. Weather conditions throughout the monitoring period were mild with light wind of not exceeding 2-3m/s on average.

Noise monitoring results are presented in the following table and graphical plot for are presented in **Appendix D**.

Date	Time	LAeq (dBA)	Limit Level (dBA)	Compliance (Yes/No)	Weather Condition
<b>CN1 San Wui Commercial Society of HK Chan Pak Sha School</b>					
2-Dec	14:40	68.6	70 <sup>#</sup>	Yes	Cloudy, wind <5m/s
9-Dec	14:45	68.7	70 <sup>#</sup>	Yes	Fine, wind <5m/s
16-Dec	14:35	65.8	70 <sup>#</sup>	Yes	Fine, wind <5m/s
23-Dec	14:20	65.9	70 <sup>#</sup>	Yes	Fine, wind <5m/s
30-Dec	14:30	63.8	70 <sup>#</sup>	Yes	Fine, wind <5m/s
<b>CN2 Holy Spirit Seminary</b>					
2-Dec	16:04	65.4	70 <sup>#</sup>	Yes	Cloudy, wind <5m/s
9-Dec	16:14	64.4	70 <sup>#</sup>	Yes	Fine, wind <5m/s
16-Dec	16:11	63.2	70 <sup>#</sup>	Yes	Fine, wind <5m/s
23-Dec	16:12	65.1	70 <sup>#</sup>	Yes	Fine, wind <5m/s
30-Dec	16:15	65.4	70 <sup>#</sup>	Yes	Fine, wind <5m/s
<b>CN3 Shun Fung Building</b>					
4-Dec	10:50	66.0	75 <sup>#</sup>	Yes	Cloudy, wind <5m/s
11-Dec	09:30	68.9	75 <sup>#</sup>	Yes	Fine, wind <5m/s
16-Dec	10:15	69.4	75 <sup>#</sup>	Yes	Fine, wind <5m/s
24-Dec	10:20	70.2	75 <sup>#</sup>	Yes	Fine, wind <5m/s
31-Dec	10:15	71.2	75 <sup>#</sup>	Yes	Fine, wind <5m/s
<b>CN4 South Horizons Phase IV – Block 25 Dover Court</b>					
4-Dec	11:15	66.1	75 <sup>#</sup>	Yes	Cloudy, wind <5m/s
11-Dec	11:05	67.9	75 <sup>#</sup>	Yes	Fine, wind <5m/s
16-Dec	11:15	66.5	75 <sup>#</sup>	Yes	Fine, wind <5m/s
24-Dec	10:45	68.2	75 <sup>#</sup>	Yes	Fine, wind <5m/s
31-Dec	11:00	67.5	75 <sup>#</sup>	Yes	Fine, wind <5m/s
<b>CN5 TWGHs Jockey Club Rehabilitation Complex Block A</b>					
2-Dec	15:12	64.2	75	Yes	Cloudy, wind <5m/s
9-Dec	15:16	62.1	75	Yes	Fine, wind <5m/s
16-Dec	15:14	63.9	75	Yes	Fine, wind <5m/s
23-Dec	15:13	64.9	75	Yes	Fine, wind <5m/s
30-Dec	15:30	64.1	75	Yes	Fine, wind <5m/s
<b>NTB1 Outside Aegean Terrace</b>					
4-Dec	10:00	57.6	75	Yes	Cloudy, wind <5m/s
11-Dec	10:20	57.8	75	Yes	Fine, wind <5m/s
16-Dec	09:55	57.4	75	Yes	Fine, wind <5m/s
24-Dec	10:00	58.6	75	Yes	Fine, wind <5m/s
31-Dec	09:50	56.4	75	Yes	Fine, wind <5m/s

(#) Or updated prediction of noise levels as contained in Construction Noise Mitigation Measures Plan

### 3.3 Water Quality

In accordance with the Silt Curtain Plan for Marine-based Decommissioning of Temporary Pier at Telegraph Bay submitted under EP condition 2.16(a), water quality monitoring will be carried out during the marine-based demolition works at the Telegraph Bay barging point. The baseline water quality monitoring at Telegraph Bay was scheduled and completed in August 2014. The Water Quality Baseline Monitoring Report for Marine-based Demolition work of the temporary pier at Telegraph Bay was submitted to EPD on 26 November 2014 and deposited at the EIAO Register Office on 4 December 2014.

#### *Monitoring Methodology*

Water quality was monitored in terms of the following parameters: Dissolved Oxygen (DO, mg/L) and Dissolved Oxygen Saturation (DO %), temperature (°C), pH, turbidity (NTU), salinity (ppt), suspended solids (mg/L) and water depth (m) in accordance with the EM&A

Manual of the HKWDT project. All parameters were measured in-situ whereas SS shall be determined by the laboratory.

Water samples were taken with a water sampler, consisting of a transparent PVC cylinder of 2 litres that can be effectively sealed with cups at both ends. The water sampler has a positive latch system to keep it open and prevent premature closure until released by a messenger when the sampler arrives is at the pre-determined depth.

Measurement was taken at 3 water depths, namely, 1m below water surface, mid-depth and 1m above sea bed, except where the water depth less than 6m, the mid-depth station may be omitted. Should the water depth be less than 3m, only the mid-depth station was monitored.

Duplicate in-situ measurements and samples were collected and analyzed to ensure a robust statistically interpretable dataset. Where the difference in value between the first and second measurement of DO or turbidity parameters is more than 25% of the value of the first reading, the reading was discarded and further readings were taken.

Water samples were stored in high-density polythene bottles, packed in ice and delivered to the laboratory of ALS Technichem (HK) Ltd., a HOKLAS accredited laboratory. The SS analyses followed the standard method APHA 2540D with a detection limit of 1mg/L.

A digital depth detector was employed to determine the water depth at selected stations when flows permit.

#### *Calibration Requirements*

On-site monitoring equipment namely the salinity meter, pH meter, turbidity meter, dissolved oxygen meter and temperature meter were calibrated before use. The methodologies for the calibration are referred to the instruction manual provided by the manufactures respectively. The calibration records are shown in **Appendix C**. Response of sensors and electrodes was checked with certified standard solutions before each use.

#### *Monitoring Results*

Impact water quality monitoring was undertaken in accordance with the Silt Curtain Plan at the respective designated monitoring locations at Telegraph Bay as shown in Table 2 during the reporting period. Monitoring results and graphical plots are presented in **Appendix D**.

### **3.4 Action taken in Event of Exceedance**

There was no exceedance in air quality and noise monitoring parameters recorded in the reporting period, therefore no action was taken.

Exceedances in turbidity and SS against Action/ Limit Levels were recorded at monitoring stations I1, I2 and Intake B on 1, 3, and 10 December 2014. The exceedances were considered not related to the project works. Please refer to **Appendix E** for the review of exceedance in water quality monitoring.

## 4. LANDSCAPE AND VISUAL

### 4.1 EM&A Requirements

The landscape and visual mitigation measures undertaken by the contractors during the construction phase have been audited on a regular basis according to the EM&A Manual.

### 4.2 Site Audit Results

Regular inspections and audits were conducted by the Certified Arborist as required by the EP and it was found that the transplanting works and the tree protection works being carried out by the civil works and transplanted contractors were in accordance with the EP/ EIA. Necessary tree removal or protection works were being carried out in accordance with the EP/ EIA or approved Tree Removal Application. No non-compliance was identified in the reporting period.

#### Retained Trees

No immediate hazards were noted for any of the OVTs during reporting period. Health conditions of the two retained and pruned trees, *Ficus elastica*, located at Wong Chuk Hang San Wai have been monitored. The contractor had enhanced the tree protection zone and was reminded to properly maintain the protection zone.

#### Transplanted Tree

Total of 464 trees of the SIL(E) had been transplanted as of the reporting month. They were mostly transplanted to the holding nursery at Chung Hom Shan and Kellett Bay, permanent receptor sites such as Lok Ma Chau, Telegraph Bay or in-situ under project areas.

## 5. ECOLOGY

### 5.1 EM&A Requirements

Auditing of the ecological mitigation measures during the construction phase have been carried out on a regular basis according to the EM&A Manual.

### 5.2 Site Audit Results

#### Ardeid Night Roost

Regular inspections to the works areas around the ardeid night roost have been conducted by the ecologist to check the ecological mitigation measures with regard to the ardeids at Wong Chuk Hang Nullah. Inspections of the ardeid night roost have been made for any active ardeid nests. Whilst ardeids have never been recorded nesting at this site, precautionary checks for active nests or signs of breeding have been made.

Monthly monitoring of the ardeid night roost location was also conducted by the ecologist from a vantage point, at Ap Lei Chau Bridge (on the Wong Chuk Hang side), with an unobstructed view over the area. According to the EM&A Manual, the surveys will commence approximately one hour before sunset and continue for 20 minutes after sunset,

or until nightfall, which comes sooner. Any aggregation of night roosting ardeid in the degraded woodland or adjacent area have been located and counted.

During the reporting month, the monthly night ardeid survey was conducted on 24 December 2014 commenced at 1640hr. No ardeids was observed roosted at this location.

Nevertheless, the roosting site at Wong Chuk Hang shall be maintained in good condition, and proper mitigation measures will be kept for the tree protection within the site. Proper tree protection measures have been implemented as far as practicable by the contractor to the current and potential roost trees retained on site.

#### Plant Species of Conservation Interest

Detailed field survey led by the ecologist was undertaken in March and early May 2011 to ascertain the presence of any rare or protected flora species to be affected. The surveys covered all above ground works areas of the project and the survey results were presented in the Detailed Transplanting Baseline Survey Report submitted under the Environmental Permit.

As in the Detailed Transplanting Baseline Survey Report, two plant species of conservation interest recorded in the degraded woodland to the south of Wong Chuk Hang Nullah, namely herb *Houttuynia cordata* and tree *Aquilaria sinensis* (including seedlings), and planted young tree *Ailanthus fordii* (including seedlings) recorded in a plantation area near Hong Kong Park will be influenced by the project works. Other plant species of conservation interest identified will be protected on-site and appropriate tree protection measures would be established if needed. Health condition of the most plant species protected in-situ generally remained unchanged as in the Detailed Transplanting Baseline Survey Report. However, it is noted that health condition of *Ailanthus fordii* (tree no. OCP-T2231), which is outside the active works area at Wong Chuk Hang San Wai, was found to remain in generally fair physiologically condition. Two *Aquilaria sinensis*, which are located outside the active works area to the north of Nam Fung Road, were found in very poor health condition and suspected to be dead specimens. The two transplanted *Aquilaria sinensis* have been removed in Nov 2013.

Regular monitoring on the transplanted *A. fordii* within the works area has been conducted. The transplanted *A. fordii* were in fair health condition and protection fences have been maintained around the receptor sites. Condition of one transplanted young seedling *A. fordii* has grown satisfactorily with new leaves developed from the apical bud. while the retained tree T3 has remained in satisfactory condition.

According to the Transplanting Proposal for *H. cordata* submitted in Sep 2011, post transplantation maintenance period were undertaken throughout the 12-month and have been completed.

## **6. WASTE MANAGEMENT**

Mitigation measures on waste management have been implemented in accordance with the site waste management plans for the respective civil works contracts. The C&D materials have been disposed of at the public fill reception facilities while C&D wastes have been disposed of at the landfills. Operation of the barging point at Telegraph Bay has been terminated by September 2014. Quantities of wastes disposed in the reporting period are summarized in the following table:

Contract No	Inert C&D Materials Disposed at Public Fill (m <sup>3</sup> )	Inert C&D Materials Reused (m <sup>3</sup> )	Non-inert Waste Disposed at Landfill (m <sup>3</sup> )	Chemical Waste to Designated Treatment Facility (litre/ kg)
Reporting Period: December 2014				
Contract 901	3,000	7,540	90	1,396
Contract 902	1,056	6,911	606	400
Contract 903	1,871	149	84	500
Contract 904	327	0	250	0
Contract 908	246	0	191	0

## 7. RECORD OF ENVIRONMENTAL COMPLAINTS

There was no environmental complaint referred by EPD in the reporting period.

## 8. RECORD OF NON-COMPLIANCES

There was no non-compliance identified in the reporting period.

## 9. RECORD OF NOTIFICATIONS OF SUMMONS AND PROSECUTIONS

No summon or prosecution related to environmental issue was received or made against the Project in the reporting period.

## 10. STATUS OF STATUTORY SUBMISSIONS

### 10.1 Submissions required under Environmental Permit

A summary of the status of submissions required under the SIL(E) Environmental Permit as of 31 December 2014 is shown below:

EP Clause No.	Description of Submission	Status
1.11	Commencement date of construction	Submitted on 25 May 2011
1.14	Commencement date of operation	To be submitted no later than 2 months prior to commencement of operation of the Project
2.1 & 2.2	Employment of IEC & ET	Submitted on 6 Apr 2011
2.3	Employment of Qualified Ecologist	Submitted on 6 Apr 2011
2.4	Employment of Certified Arborist	Updated Certified Arborist submitted on 19 Aug 2013
2.5	Management organization of main construction companies	Updated main construction companies submitted on 15 Jun 2012

EP Clause No.	Description of Submission	Status
2.6	Construction programme & EP submission schedule	Submitted on 10 Jun 2011
2.7	Set up of Community Liaison Group	Submitted on 20 Apr 2011
2.8	Updated EM&A Manual	EP Condition fulfilled dated 13 February 2012
2.9	Construction Noise Mitigation Measures Plan	Updated Construction Noise Mitigation Measures Plan submitted on 11 May 2012 and EP Condition fulfilled date 22 May 2012
2.11	Construction & demolition materials management plan for barging points	Revised Construction & Demolition Materials Management Plan re-submitted on 7 January 2014.
2.13 (a)	Ecological planting & landscape plan	Revised plan submitted on 22 May 2014 , EP Condition fulfilled dated 27 Jun 2014
2.13 (b)	As built drawings of ecological planting & landscape works	To be submitted no later than 1 month after completion of planting works (at Wong Chuk Hang nullah)
2.13 (c)	Final monitoring report of ecological planting & landscape works	To be submitted no later than 1 month after completion of the 3-year post planting care and maintenance period
2.14 (a)	Detailed transplanting baseline survey report for plant species of conservation interest	Resubmitted on 8 Sep 2011 and no further comment received
2.14 (b)	Transplantation proposal for plant species of conservation interest	H. cordata: EP Condition fulfilled dated 15 Sep 2011 Aq. sinensis: EP Condition fulfilled dated 21 Feb 2012 Ai. fordii: EP Condition fulfilled dated 18 Oct 2011
2.14 (c)	As built drawings of transplanting works for plant species of conservation interest	H. cordata: EP Condition fulfilled dated 15 Sep 2011 Aq. sinensis: EP Condition fulfilled dated 2 May 2012 Ai. fordii: EP Condition fulfilled dated 22 Dec 2011
2.15	Tree protection plan	Updated Tree protection plan submitted on 4 May 2012 and EP Condition fulfilled dated 30 May 2012
2.16(a)	Silt curtain plan	For Aberdeen Channel: EP Condition fulfilled dated 12 Aug 2011 For Telegraph Bay: EP Condition fulfilled dated 14 Dec 2011 Water Quality Baseline Monitoring Report for Marine-based Demolition work of the temporary pier at Telegraph Bay was submitted to EPD on 26 Nov 2014 and deposited in EIAO Registered Office on 4 Dec 2014

EP Clause No.	Description of Submission	Status
2.17(b)	Sample test results for on-site re-use of marine sediment	EP Condition fulfilled dated 26 Apr 2013
2.17(c)	Sediment Sampling Report	EP Condition fulfilled dated 11 Jun 2014
2.25	Operational groundborne noise review plan	Resubmitted on 2 Jul 2014 and EP Condition fulfilled dated 22 Jul 2014
2.26	Operational groundborne noise mitigation measures plan	Resubmitted on 2 Jul 2014 and EP Condition fulfilled dated 22 Jul 2014
2.27	As built drawings for operational groundborne noise mitigation measures	To be submitted no later than 1 month after completion of tracks installation
2.29	As built drawings for operational airborne noise mitigation measures on viaduct section	To be submitted no later than 1 month after completion of noise mitigation measures installation on viaduct section
2.30	Noise performance test report	To be submitted no later than 1 month prior to commencement of operation of the Project
2.31	Fixed plant noise audit report	To be submitted no later than 1 month prior to commencement of operation of the Project
2.32	Visual & landscape plan	Part1-Site No.6 Nam Fung Portal: EP Condition fulfilled dated 25 Jun 2013 Part2-Chung Hom Shan Magazine Site: EP Condition fulfilled dated 13 Oct 2014 Part3-EPIW Footbridge to Ap Lei Chau Estate: Submitted on 28 Nov 2014, comments received on 18 Dec 2014 Part4-Wong Chuk Hang Depot: Submitted on 16 Dec 2014
3.1	Environmental Monitoring and Audit Requirements	Termination of water quality monitoring at Aberdeen Channel approved on 23 Dec 2013  Requirements of noise and air quality impact monitoring at Telegraph Bay as recommended in the C&DMMP was fulfilled on 6 Nov 2014.
3.3	Baseline monitoring report	EP Condition fulfilled dated 21 Feb 2012
3.4	Monthly EM&A reports	Submit within 2 weeks after the end of the reporting month
4.2	Internet address of EM&A and project data	Update of internet address submitted on 24 Dec 2014

## 10.2 Statutory Permits and Licenses

A summary of the status of all relevant environmental permit and licenses as of 31 December 2014 is shown below:

Description		Effective Date	Expiry Date
Environmental Permit for South Island Line (East)	EP-407/2010/E	29/8/2014	N/A
<b>Contract 901</b>			
Chemical Waste Producer Licence	5213-124-K3004-01	23/5/2011	N/A
Waste Disposal (Trucks)	7012859	1/6/2011	N/A
Water Discharge Licence	WT00015547-2013	26/3/2013	31/7/2016
CNP for SEE Shaft and Stationbox	GW-RS0873-14	1/9/2014	28/2/2015
CNP for SEE Shaft and Stationbox (Renewal)	submitted on 10 Dec 2014		
CNP for Large Plants Delivery	GW-RS0864-14	11/9/2014	9/3/2015
CNP for Ventilation Shaft Dismantling	GW-RS0560-14	27/6/2014	25/12/2014
CNP for Ventilation Shaft Dismantling (Renewal)	GW-RS1350-14	26/12/2014	24/6/2015
CNP for A&A works at Admiralty Station	GW-RS0497-14	10/6/2014	8/12/2014
CNP for A&A works at Admiralty Station (Renewal)	GW-RS1337-14	9/12/2014	19/5/2015
<b>Contract 902</b>			
Chemical Waste Producer Licence (Nam Fung)	5213-175-N2206-12	24/6/2011	N/A
Chemical Waste Producer Licence (HK Park)	5213-124-N2345-02	28/10/2011	N/A
Chemical Waste Producer Licence (Telegraph Bay)	5213-171-N2206-24	17/4/2012	N/A
Waste Disposal (Trucks)	7012912	26/5/2011	N/A
Waste Disposal (Vessels)	7015920	14/5/2014	2/9/2014
Water Discharge Licence for HK Park	WT00009688-2011	22/7/2011	31/7/2016
Water Discharge Licence for Nam Fung Path	WT00009749-2011	22/7/2011	31/7/2016
Water Discharge Licence for CHS Magazine	WT00009842-2011	11/8/2011	31/8/2016
Water Discharge Licence for Telegraph Bay Barging Point	WT00010649-2011	27/10/2011	31/10/2016
CNP for Nam Fung 24-hour Tunnel Excavation (Drop Gate at CH1200)	GW-RS1233-14	3/11/2014	2/5/2015
CNP for HK Park 24-hour Shaft Excavation	GW-RS0002-15	08/01/2015	30/6/2014
CNP for Telegraph Bay reinstatement	GW-RS1134-14	15/10/2014	14/4/2015
CNP for Chung Hom Shan Magazine site reinstatement	GW-RS1433-14	24/12/2014	23/6/2015
<b>Contract 903</b>			
Chemical Waste Producer Licence (Ocean Park Station)	5213-175-L2174-31	14/6/2011	N/A
Chemical Waste Producer Licence (Ap Lei Bridge)	5213-175-L2174-32	30/6/2011	N/A
Chemical Waste Producer Licence (Zone D)	5213-175-L2174-33	30/6/2011	N/A
Chemical Waste Producer Licence (Nam Long Shan Sitting Out Area)	5213-175-L2174-34	30/6/2011	N/A
Chemical Waste Producer Licence (Wong Chuk Hang Station)	5213-175-L2174-35	30/6/2011	N/A
Waste Disposal	7012721	12/5/2011	N/A
Water Discharge Licence for Ap Lei Chau Bridge	WT00009838-2011	5/8/2011	31/8/2016

Description		Effective Date	Expiry Date
Water Discharge Licence for for all pier areas Zone B	WT00009931-2011	16/8/2011	31/8/2016
Water Discharge Licence for OCP station	WT00010501-2011	3/10/2011	31/10/2016
Water Discharge Licence for Zone D	WT00010319-2011	3/10/2011	31/10/2016
Water Discharge Licence for Zone C	WT00010648-2011	24/10/2011	31/10/2016
Water Discharge Licence for WCH Station	WT00014046-2012	24/9/2012	31/8/2016
Water Discharge Licence for Utilities Work Area Along Heung Yip Road	WT00014047-2012	25/9/2012	30/9/2017
Water Discharge Licence for Kwun Hoi Path	WT00015968-2013	2/5/2013	31/5/2018
Water Discharge Licence for Nam Long Shan Road Sitting out area	WT00018070-2013	2/1/2014	31/1/2019
Water Discharge Licence for Yip Kan Street	WT00018301-2014	18/2/2014	28/2/2019
CNP for ABWF in WCH Station (Renewal of GW-RS0588-14)	GW-RS1437-14	27/12/2014	26/06/2015
CNP for Noise Barrier Installation in Zone E Viaduct (E3-E4) (Renewal of GW-RS0824-14)	GW-RS1445-14	01/01/2015	30/06/2015
CNP for Noise Barrier Installation in Zone C Viaduct (C0-C9) (Renewal of GW-RS0823-14)	GW-RS1447-14	31/12/2014	30/06/2015
CNP for Noise Barrier Installation in Zone C Viaduct (C9-C16) (Renewal of GW-RS0829-14)	GW-RS1444-14	31/12/2014	30/06/2015
CNP for Noise Barrier Installation in Zone D Viaduct (D0-D4) (Renewal of GW-RS0845-14)	GW-RS1446-14	31/12/2014	30/06/2015
CNP for WCH Footbridge Construction (Renewal of GW-RS0793-14)	GW-RS1434-14	01/01/2015	30/06/2015
CNP for Noise Barrier Installation in Zone B	GW-RS0993-14	12/09/2014	11/03/2015
CNP for ABWF works in OCP Station (Renewal of GW-RS0119-14)	GW-RS0878-14	20/08/2014	18/02/2015
CNP for Noise Barrier Installation in Zone D Viaduct (D8-D12) (Renewal of GW-RS0332-14)	GW-RS1137-14	19/10/2014	12/04/2015
CNP for Zone D (Water pump for D13 Stoplog) (Renewal of GW-RS0354-14)	GW-RS1186-14	29/10/2014	28/04/2015
CNP for Noise Barrier Installation in Zone B (B4)	GW-RS1180-14	29/10/2014	31/12/2014
<b>Contract 904</b>			
Chemical Waste Producer License for ALC Bridge Rd near Sham Wan Towers	5111-174-L2758-04	4/8/2011	N/A
Chemical Waste Producer License for ALC Bridge Rd near Harbour Mission School	5111-174-L2758-03	4/8/2011	N/A
Chemical Waste Producer License for ALC Main Street near Sunny Court	5111-174-L2758-05	4/8/2011	N/A
Chemical Waste Producer License for Lei Tung Estate Rd near Kaifong Primary School	5111-174-L2758-02	4/8/2011	N/A
Chemical Waste Producer License for Lee Nam Rd Sitting Out Area	5111-174-L2758-01	4/8/2011	N/A
Chemical Waste Producer License for Lee Nam Rd Sitting Out Area No. 2	5111-174-L2758-07	4/8/2011	N/A
Chemical Waste Producer License for Yi Nam Rd intersect with Lee Nam Rd & SOH Drive	5111-174-L2758-06	4/8/2011	N/A
Waste Disposal (Trucks)	7012979	25/6/2011	N/A
Waste Disposal (Vessels)	7015570	23/7/2012	N/A
Water Discharge License for ALC Bridge Rd near Sham Wan Towers	WT00009781-2011	5/8/2011	31/8/2016

Description		Effective Date	Expiry Date
Water Discharge License for ALC Bridge Rd near Harbour Mission School	WT00009778-2011	5/8/2011	31/8/2016
Water Discharge License for ALC Main Street near Sunny Court	WT00009777-2011	5/8/2011	31/8/2016
Water Discharge License for Lei Tung Estate Rd near Kaifong Primary School	WT00009780-2011	5/8/2011	31/8/2016
Water Discharge License for Lee Nam Rd Sitting Out Area	WT00009779-2011	5/8/2011	31/8/2016
Water Discharge License for Lee Nam Rd Sitting Out Area No. 2	WT00009783-2011	5/8/2011	31/8/2016
Water Discharge License for Yi Nam Rd intersect with Lee Nam Rd & SOH Drive	WT00009775-2011	5/8/2011	31/8/2016
Water Discharge License for Barging Point at Lee Nam Road J/O Lee King Street	WT00014348-2012	5/11/2012	30/11/2017
CNP for SOH Package 2 and 3 Pumping Test and grouting station near HK Electric	GW-RS0690-14	20/7/2014	19/1/2015
CNP for PCW at Lee Wing Adit J/O Main Tunnel	GW-RS1359-14	3/12/2014	1/6/2015
CNP for drainage work at Lee Wing Street	GW-RS1057-14	6/10/2014	31/12/2014
CNP for 24hr PCW at Lei Tung Station (Concourse Level), Adit B and Lei Tung Entrance Shaft	GW-RS1155-14	21/10/2014	16/4/2015
<b>Contract 908</b>			
Waste Disposal	7014839	20/3/2012	N/A
Chemical Waste Producer Licence	5211-175-H2913-42	11/4/2012	N/A
Water Discharge Licence	WT000013232-2012	29/6/2012	31/5/2017
CNP for water pumping, water jetting unit, water treatment plant, Grout mixer, Grout pump, Hand drill and mobile platform	GW-RS1255-14	10/11/2014	9/5/2015

## 11. SITE INSPECTIONS

### 11.1 Implementation of Environmental Mitigation Measures

Regular site inspections were undertaken by the ET in accordance with the EM&A Manual to check the implementation of environmental mitigation measures in the EIA. The contractors' performance on environmental matters was assessed. The environmental mitigation measures are being implemented by the civil works contractors where appropriate. A schedule of the implementation of mitigation measures identified in the SIL(E) EIA is given in **Appendix F**.

### 11.2 Observations

The findings from the site inspections and the associated recommendations on improvement to the environmental protection and pollution control works were raised to the contractors for reference and/ or action. Observations against the implementation of the mitigation measures recommended in the EP/ EIA are summarized as follows:

Item	Description	Follow up Status
<b>Contract 901</b>		
1	The contractor was reminded to provide drip trays for chemicals and clear the content in drip trays as chemical waste.	On-going
2	The contractor was reminded to repair the pH neutralization unit of wastewater treatment system and improve the effluent quality.	Improved and standard to be maintained
3	The contractor was reminded to improve general housekeeping on site.	Improved and standard to be maintained
4	The contractor was reminded to keep the site entrance free of dusty materials.	On-going
5	The contractor was reminded to clear refuse and silt deposited in drainage.	On-going
<b>Contract 902</b>		
1	The contractor was reminded to properly maintain the site drainage system and provide adequate silt removal facilities.	Improved and standard to be maintained
2	The contractor was reminded to maintain dust suppression measures.	Improved and standard to be maintained
3	The contractor was reminded to properly maintain the dust and noise control measures at barging point	Improved and standard to be maintained
4	The contractor was reminded to maintain proper tree protection works	On-going
<b>Contract 903</b>		
1	The contractor was reminded to maintain proper mitigation measures in the nullah for the effluent control.	On-going
2	The contractor was reminded to maintain dust suppression measures.	On-going
3	The contractor was reminded to maintain the access and egress free from dust and keep good housekeeping.	On-going
4	The contractor was reminded to handle the chemical waste on site properly.	On-going
5	The contractor was reminded to improve tree protection works.	On-going
<b>Contract 904</b>		
1	The contractor have provided the noise mitigation measures for the noisy works and was reminded to properly maintain the noise mitigation measures.	Improved and standard to be maintained
2	The contractor was reminded to provide drip tray to chemicals being used on site.	Improved and standard to be maintained
3	The contractor was reminded to maintain good housekeeping.	Improved and standard to be maintained
4	The contractor was reminded to provide adequate silt removal facilities, as well as properly maintain the site drainage system and discharge.	Improved and standard to be maintained
5	The contractor was reminded to cover the stockpile and provide frequent watering.	Improved and standard to be maintained
6	The contractor was reminded to maintain proper tree protection and maintenance works.	Improved and standard to be maintained

	<b>Contract 908</b>	
1	The contractor was reminded that the stockpiles should be covered entirely by impervious sheetings.	On-going
2	The contractor was reminded to remove C&D wastes in a timely manner	On-going

### 11.3 Solid and Liquid Waste Management Status

Base on the findings of the site inspections, the Contractors' performance in solid and liquid waste management were acceptable and compliance with the EIA requirements were demonstrated. The current management standard should be maintained.

### 11.4 Other Notable Events

#### IEC Site Inspections

The IEC conducted site inspections for respective works areas on 10, 23 and 29 December 2014. Minor irregularities including provision of movable noise barriers as necessary and enhancing site drainage system, dust suppression measures and provision of protection on the retained trees were observed during the site inspections. Follow up actions had been taken by the respective civil works contractors.

## 12. FUTURE KEY ISSUES

Future key issues envisaged in the coming month include noise, dust and wastewater from site works, disposal of C&D wastes arising as well as tree protection on site. The ET will continue the implementation of the EM&A programme in accordance to the EM&A Manual.

## 13. CONCLUSIONS

It is concluded from the environmental monitoring and audit works for the SIL(E) Project that the construction works were undertaken in an appropriately environmentally sensitive manner in the reporting period. The environmental protection and pollution control measures provided by the respective civil works contractors were generally acceptable apart from some minor irregularities which were rectified timely by the contractors.

The ET will continue the implementation of the EM&A programme in accordance to the EM&A Manual and to a level consistent with MTRCL's Corporate Sustainability Policy.

## FIGURES

Figures 1 to 2  
Works Areas of the Project

Figures 3 to 6  
Location of Construction Air Quality  
Monitoring Stations

Figures 7 to 8  
Location of Construction Noise  
Monitoring Stations

Figure 9  
Air Quality and Noise Monitoring Locations for  
Telegraph Bay Barging Point

Figure 10  
Water Quality Monitoring Locations for  
Telegraph Bay Barging Point



Figure 2 – Works Areas of the Project (2 of 2)

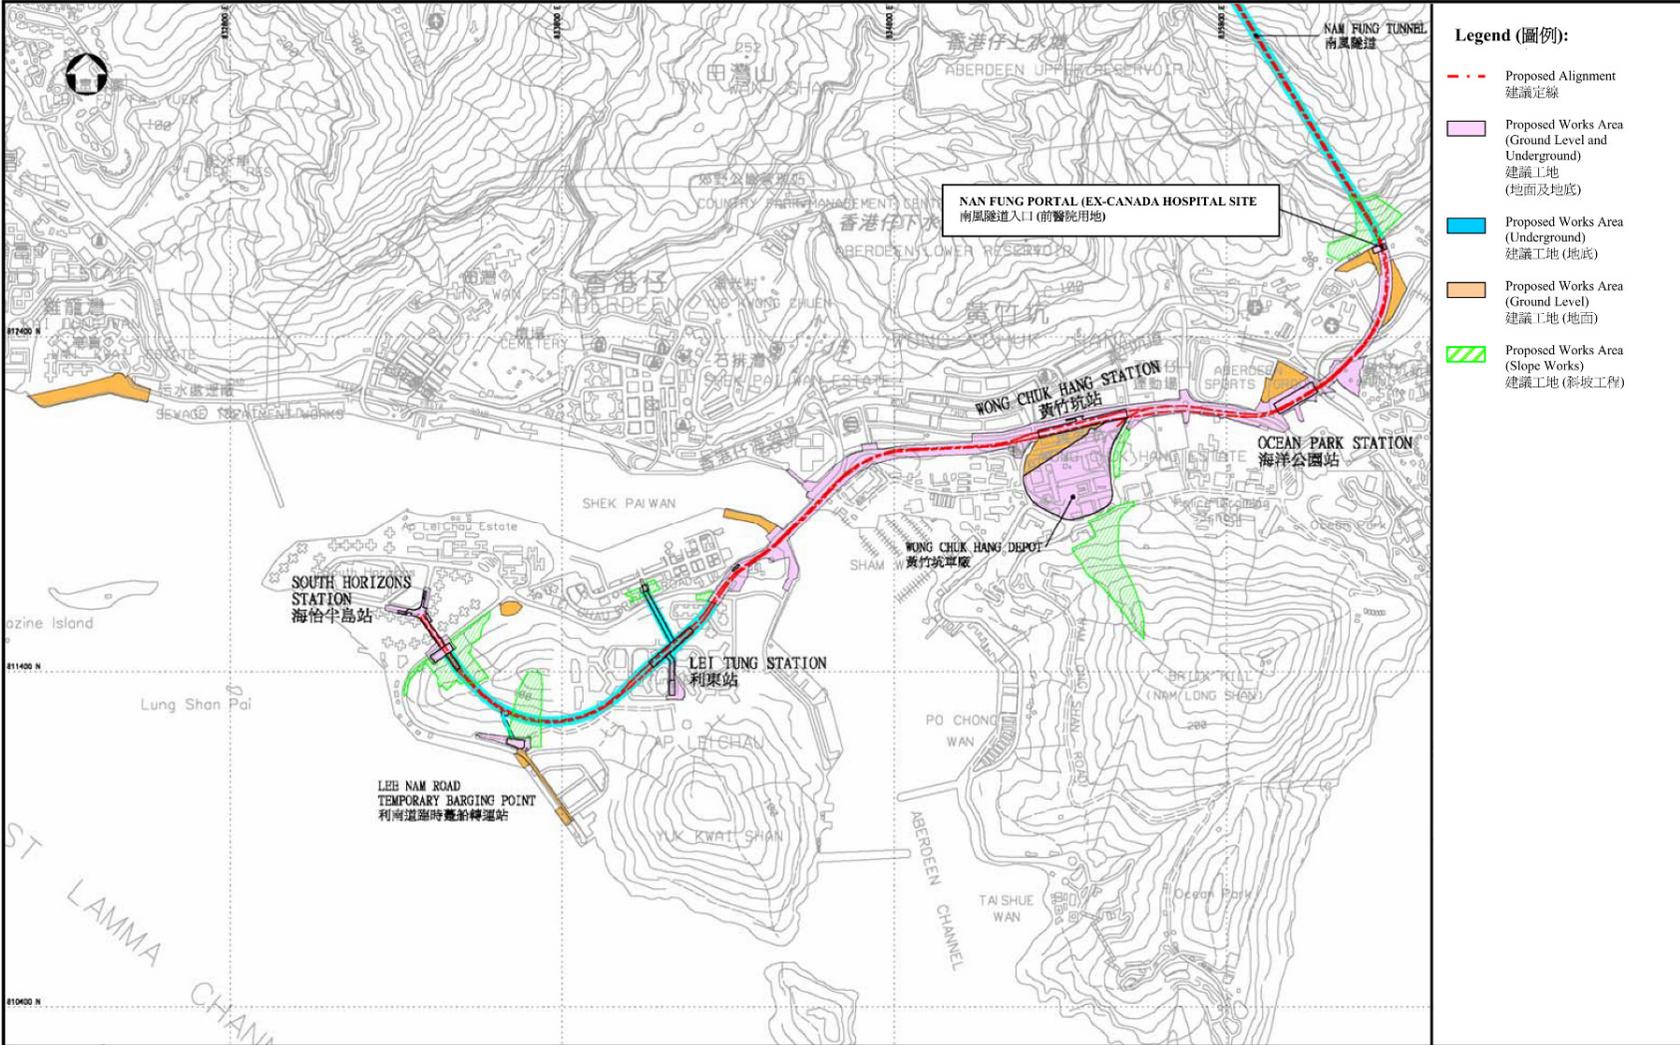


Figure 3 – Location of Construction Air Quality Monitoring Stations (1 of 4)

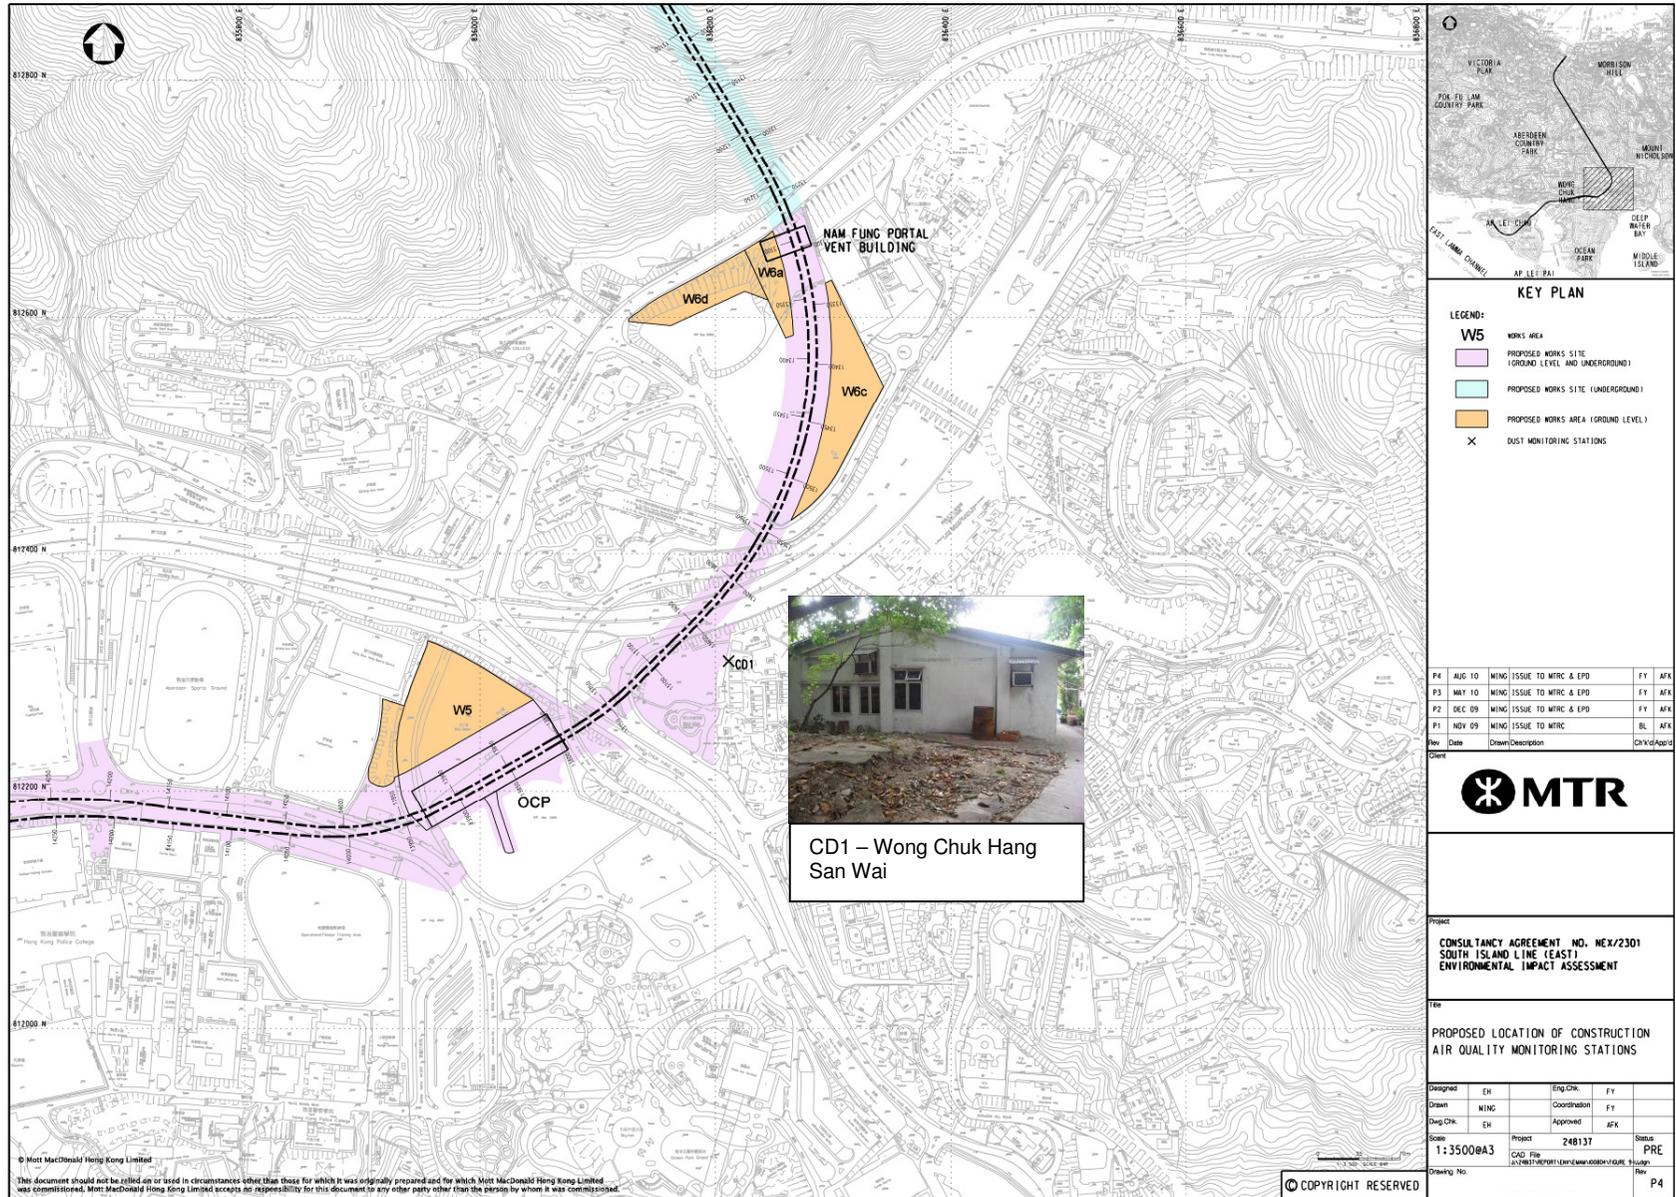


Figure 4 – Location of Construction Air Quality Monitoring Stations (2 of 4)

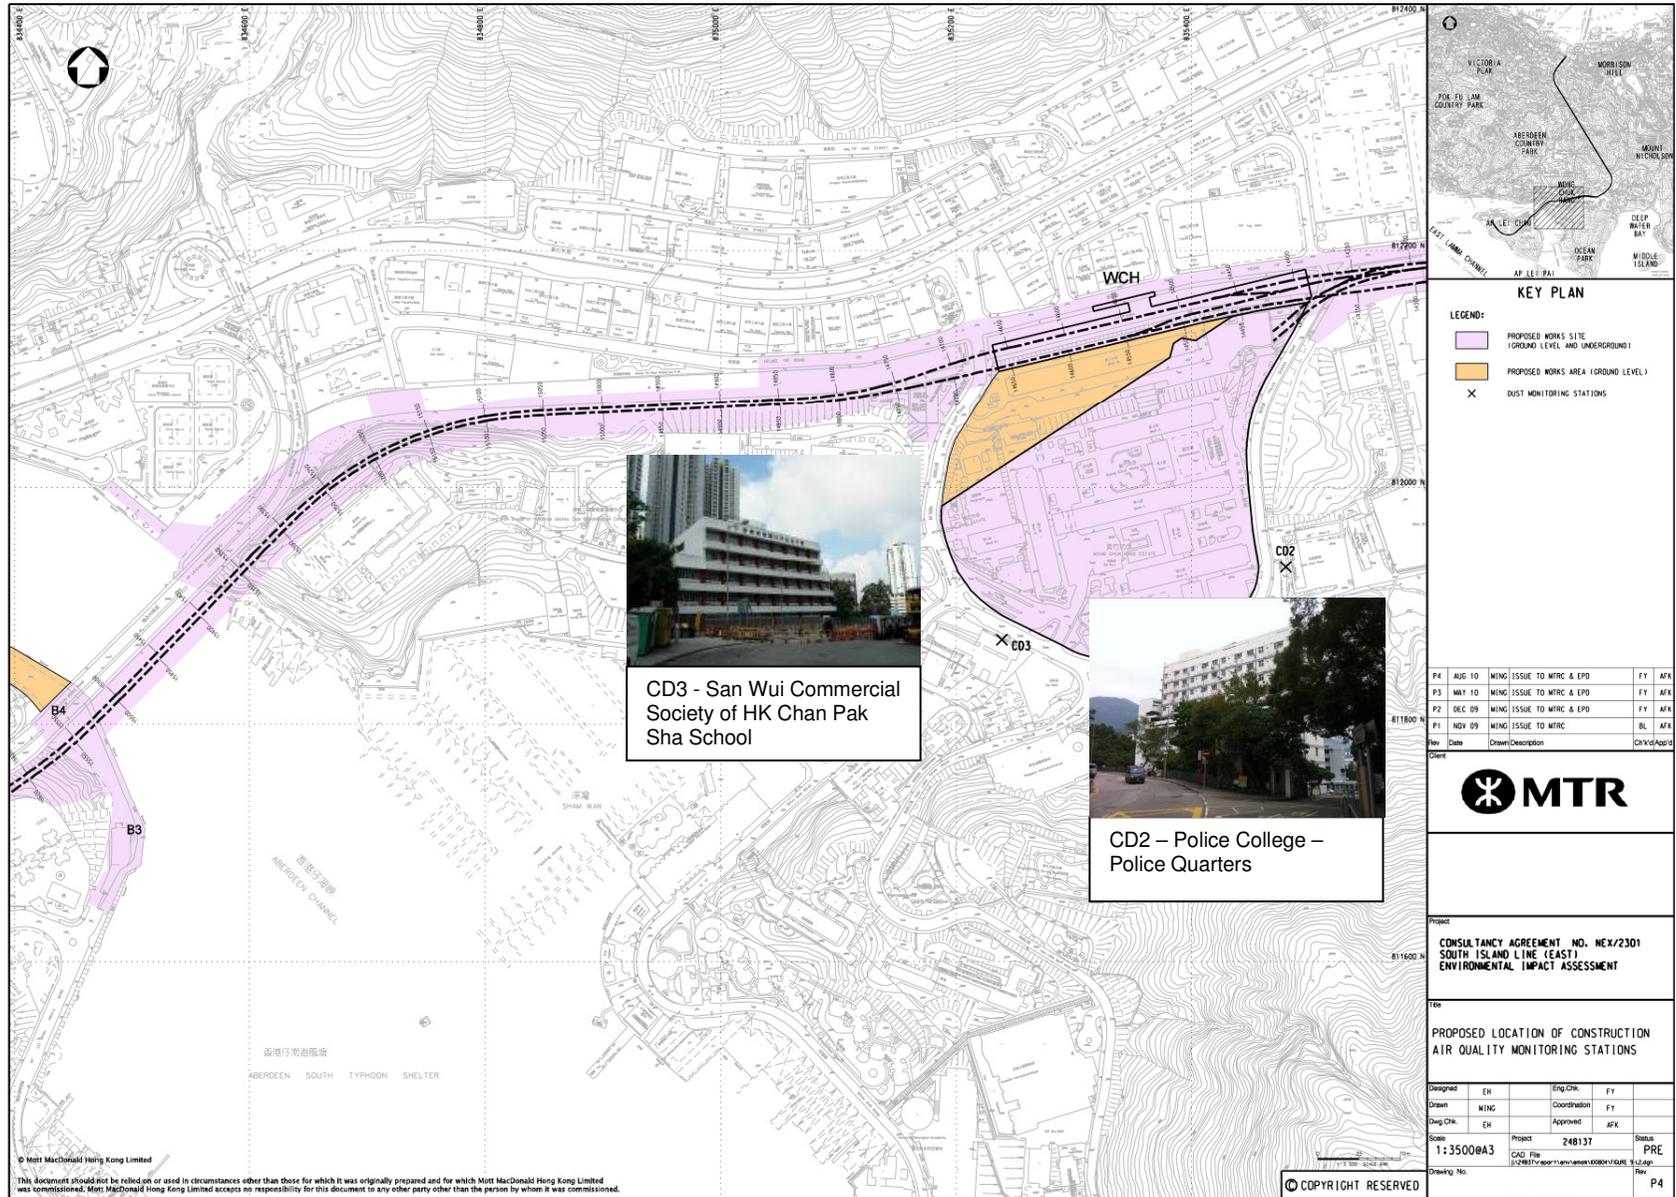


Figure 5 – Location of Construction Air Quality Monitoring Stations (3 of 4)



"This document should not be relied on or used in circumstances other than those for which it was originally prepared and for which Mott MacDonald Hong Kong Limited was commissioned. Mott MacDonald Hong Kong Limited accepts no responsibility for this document to any other party other than the person to whom it was commissioned."

Figure 6 – Location of Construction Air Quality Monitoring Stations (4 of 4)



Figure 7 – Location of Construction Noise Monitoring Stations (1 of 2)

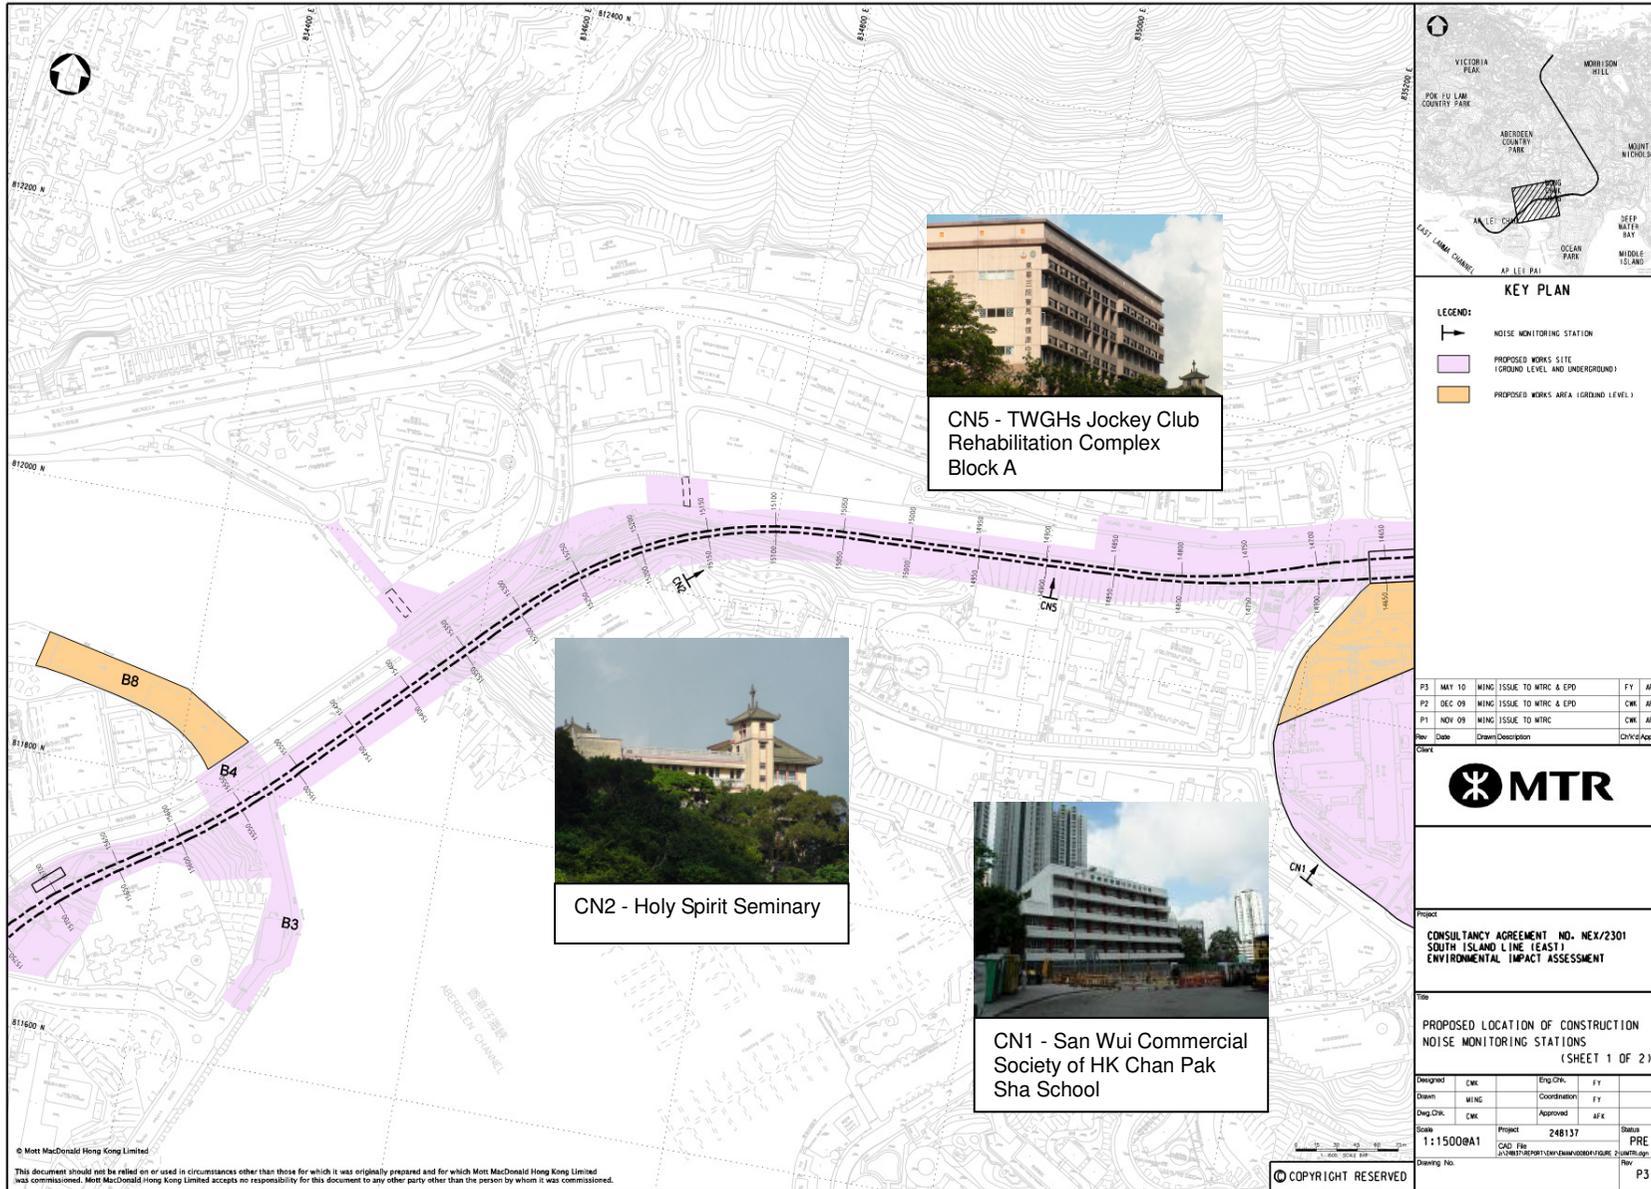


Figure 8 – Location of Construction Noise Monitoring Stations (2 of 2)

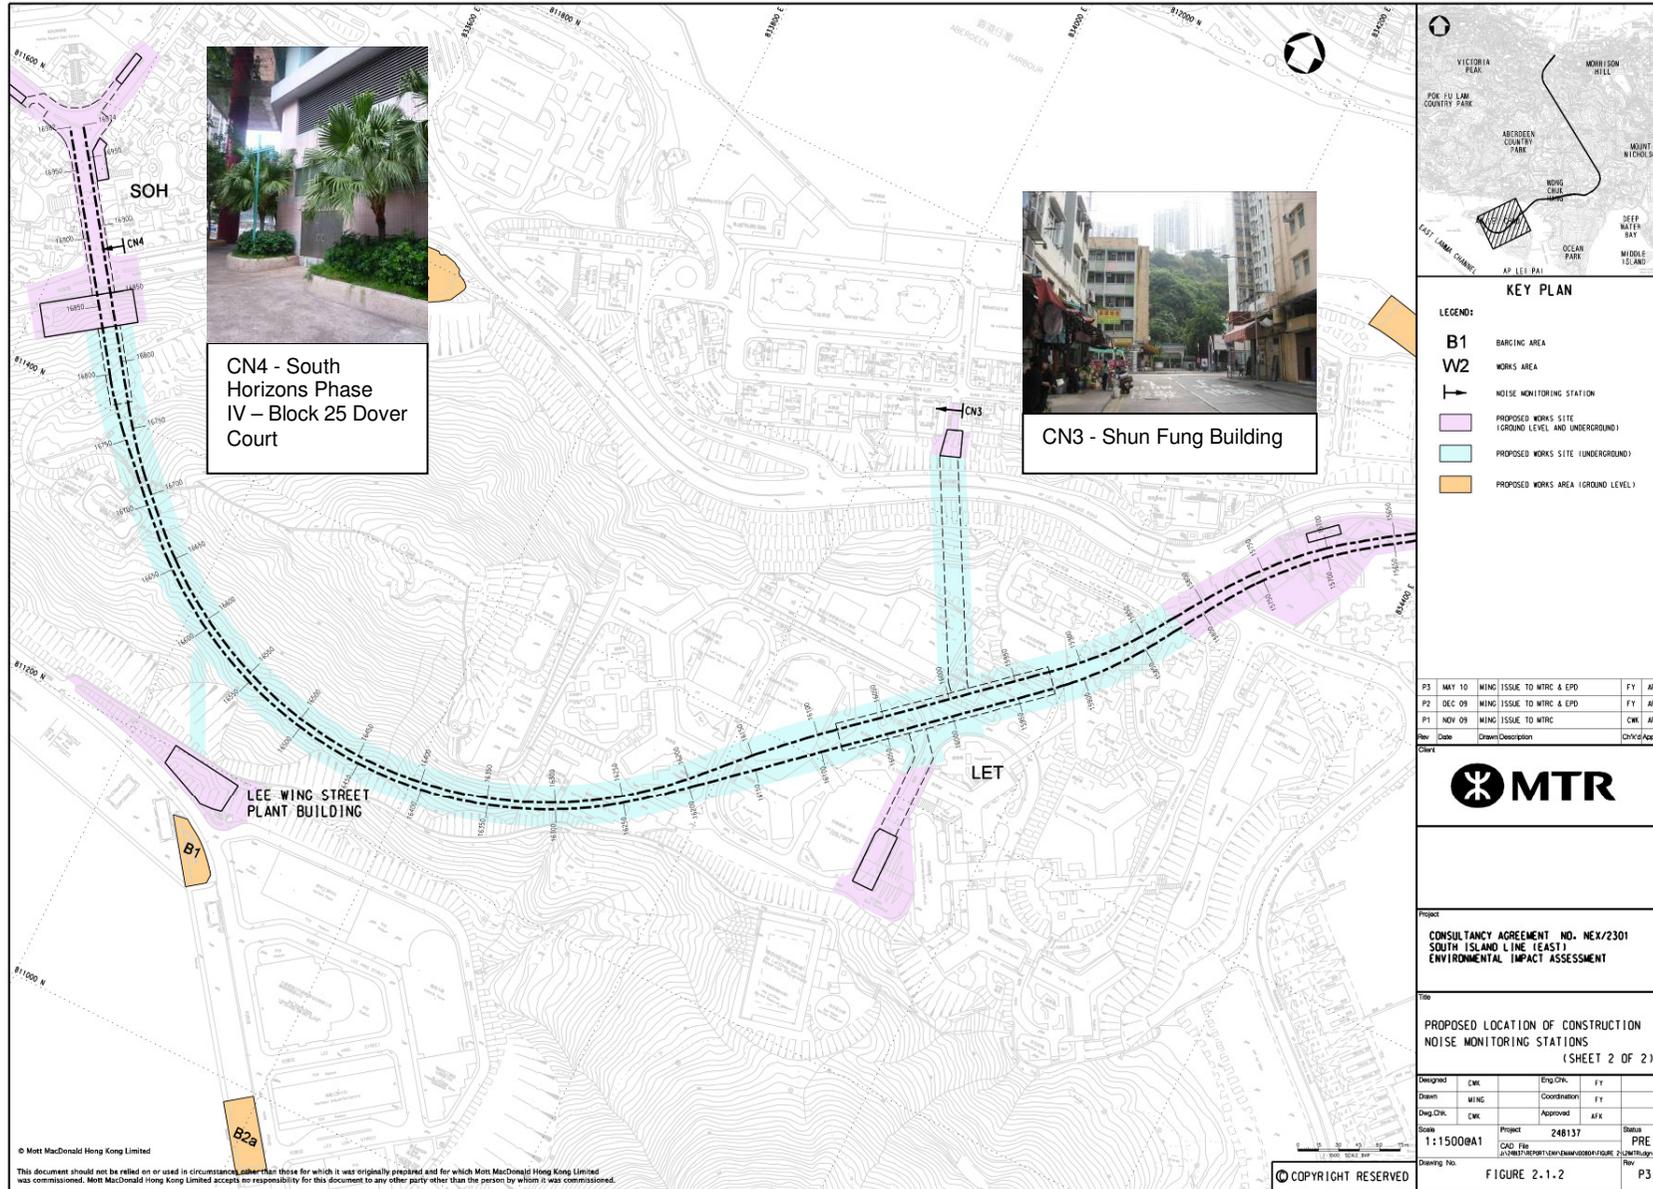


Figure 9 –Air Quality and Noise Monitoring Locations for Telegraph Bay Barging Point

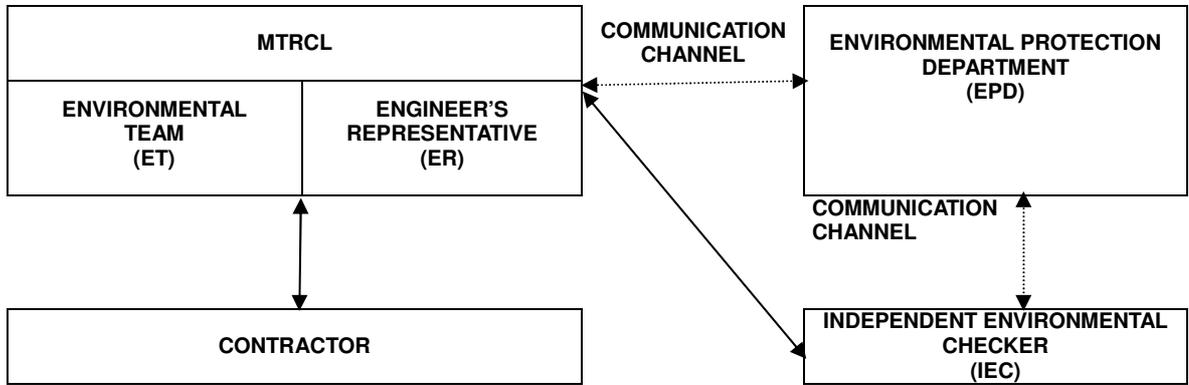


Figure 10 –Water Quality Monitoring Locations for Telegraph Bay Barging Point



APPENDIX A1  
Project Organization

Appendix A1  
Project Organization and Lines of Communications



## APPENDIX A2

### Contact List of Key Personal of the Project

Appendix A2  
Contact List of Key Personnel

**Table A2.1 Contact List of Key Personnel of Project Management**

<b>Organization</b>	<b>Name</b>	<b>Telephone</b>
<b>Independent Environmental Checker</b>	Mr. Thomas Chan	2268 3093
<b>Environmental Team Leader</b>	Mr. Richard Kwan	2688 1179
<b>Engineer's Representative</b>		
Project Manager – SIL Civil	Mr. Ken Wong	3987 8288
Construction Manager – SIL (901)	Mr. Mike Bezzano	2206 8688
Sr Construction Engineer – SIL (902)	Mr. Lawrence Lee	3519 4420
Construction Manager – SIL (903 / 904)	Mr. Jimmy Poon	2285 4688
Sr Construction Engineer – SIL (903 / 908)	Ms. Patty Kwan	3975 6950
<b>Contract No. 901</b>		
<b>Admiralty Integrated Station and SCL Enabling Works</b>		
Main Contractor: Kier – Laing O'Rourke – Kaden Joint Venture		
Project Director	Mr. Viv Jones	9248 8482
QA & Environmental Manager	Mr. Ronald Fung	9777 7667
<b>Contract No. 902</b>		
<b>Nam Fung Tunnel and Ventilation Buildings</b>		
Main Contractor: Nishimatsu Construction Co., Ltd.		
Project Manager	Mr. Masanori Ishii	6112 6707
Senior Construction Manager (External)	Toshiya Fujita	3190 7500
Senior Construction Manager (Tunnel)	Norihisa Murakawa	3190 7500
<b>Contract No. 903</b>		
<b>Ocean Park Station, Wong Chuk Hang Station, Viaduct and Aberdeen Channel Bridge</b>		
Main Contractor: Leighton Contractors (Asia) Ltd.		
Project Manager	Mr. Au Wing Chung	9319 8198
Construction Manager	Mr. Gary Chow	9162 1142
<b>Contract No. 904</b>		
<b>Lei Tung Station, South Horizons Station and Tunnels</b>		
Main Contractor: Leighton – John Holland Joint Venture		
Operation Manager	Mr. Paul Freeman	9856 1988
Project Director	Mr. Jan Torka	6323 9468

<b>Organization</b>	<b>Name</b>	<b>Telephone</b>
<b>Contract No. 908</b>		
<b>Wong Chuk Hang Depot Superstructure</b>		
Main Contractor: Hsin Chong Construction Company Limited		
Project Manager	Mr. Eric Chan	6404 0775
Deputy Project Manager	Mr. Foster Tsang	9105 3265

**Table A2.2 Contact List of Key Personnel of EPD**

<b>Organization</b>	<b>Name</b>	<b>Telephone</b>
<b>EPD</b>		
Sr Env Protection Offr (Metro Assessment)	Mr. Steve Li	2835 1142
Sr Env Protection Offr (Regional S)	Dr. Anthony Lee	2516 1802
Sr Env Protection Offr (Regional S)	Mr. Sean Law	2516 1806

## APPENDIX B1

### Action and Limit Levels for Construction Noise and Air Quality

Appendix B1

Action and Limit Levels for Construction Noise and Air Quality

**Action and Limit Levels for 24-hours TSP**

***Table B1.1 Action and Limit Levels for 24-hour TSP***

<b>ID</b>	<b>Description</b>	<b>Action Level (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Limit Level (<math>\mu\text{g}/\text{m}^3</math>)</b>
CD1	Wong Chuk Hang San Wai	173	260
CD2	Police College – Police Quarters	184	260
CD3	San Wui Commercial Society of HK Chan Pak Sha School	169	260
CD4	Shan On House	176	260
CD5	South Horizons Phase IV – Block 25	169	260

Note: TSP levels are to the nearest whole number, with values of 0.5 rounded up

**Action and Limit Levels for 1-hour TSP**

***Table B1.2 Action and Limit Levels for 1-hour TSP***

<b>ID</b>	<b>Description</b>	<b>Action Level (<math>\mu\text{g}/\text{m}^3</math>)</b>	<b>Limit Level (<math>\mu\text{g}/\text{m}^3</math>)</b>
CD1	Wong Chuk Hang San Wai	315	500
CD2	Police College – Police Quarters	311	500
CD3	San Wui Commercial Society of HK Chan Pak Sha School	322	500
CD4	Shan On House	318	500
CD5	South Horizons Phase IV – Block 25	336	500

Note: 1-hour TSP criterion recommended in the EIAO-TM  
TSP levels are to the nearest whole number, with values of 0.5 rounded up

## Action and Limit Levels for Construction Noise

**Table B1.3 Action and Limit Levels for Construction Noise**

Time Period	Action Level	Limit Level
Daytime (0700-1900), Monday through Saturday excluding Public Holidays	When one document complaint received.	$L_{Aeq\ 30mins} 75dB(A)^{(1)(2)}$
All evenings (1900-2300)		Subject to control under the Noise Control Ordinance
General Holidays (including all Sundays) during the daytime and evening (0700-2300)		Subject to control under the Noise Control Ordinance
All night time periods (2300-0700)		Subject to control under the Noise Control Ordinance

(1) 70dB(A) for schools and 65dB(A) during school examination periods.

(2) Updated prediction of noise levels as contained in the construction noise mitigation measures plan.

## APPENDIX B2

### Action and Limit Levels for Water Quality

Appendix B2  
Action and Limit Levels for Water Quality

**Table B2.1 Action and Limit Levels for Ebb Condition**

Tide: <b>Ebb</b>				
Location: <b>I1</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.9	Surface	4.6
	Middle	4.3	Middle	4.2
	Bottom	3.0	Bottom	3.0
SS in mg/L (depth averaged)	5.2		5.3	
Turbidity in NTU (depth averaged)	6.0		6.1	
Tide: <b>Ebb</b>				
Location: <b>I2</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	5.0	Surface	4.7
	Middle	3.6	Middle	3.4
	Bottom	2.7	Bottom	2.5
SS in mg/L (depth averaged)	6.2		6.3	
Turbidity in NTU (depth averaged)	6.0		6.1	
Tide: <b>Ebb</b>				
Location: <b>Intake A</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.7	Surface	4.5
	Middle	4.2	Middle	3.9
	Bottom	2.9	Bottom	2.7
SS in mg/L (depth averaged)	6.5		6.9	
Turbidity in NTU (depth averaged)	6.5		7.0	
Tide: <b>Ebb</b>				
Location: <b>Intake B</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.7	Surface	4.6
	Middle	4.0	Middle	3.9
	Bottom	2.9	Bottom	2.6
SS in mg/L (depth averaged)	6.7		7.5	
Turbidity in NTU (depth averaged)	8.9		10.2	

**Table B2.2 Action and Limit Levels for Flood Condition**

Tide: <b>Flood</b>				
Location: <b>I1</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.5	Surface	4.5
	Middle	3.4	Middle	3.1
	Bottom	2.5	Bottom	2.2
SS in mg/L (depth averaged)	6.9		7.0	
Turbidity in NTU (depth averaged)	6.3		6.3	
Tide: <b>Flood</b>				
Location: <b>I2</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.5	Surface	4.5
	Middle	3.7	Middle	3.4
	Bottom	2.6	Bottom	2.2
SS in mg/L (depth averaged)	6.8		7.2	
Turbidity in NTU (depth averaged)	5.3		5.3	
Tide: <b>Flood</b>				
Location: <b>Intake A</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.3	Surface	4.2
	Middle	3.7	Middle	3.7
	Bottom	3.2	Bottom	3.1
SS in mg/L (depth averaged)	7.3		7.5	
Turbidity in NTU (depth averaged)	6.0		6.3	
Tide: <b>Flood</b>				
Location: <b>Intake B</b>				
Parameters	Action Level		Limit Level	
DO in mg/L	Surface	4.0	Surface	4.0
	Middle	3.2	Middle	3.1
	Bottom	2.7	Bottom	2.6
SS in mg/L (depth averaged)	7.0		7.4	
Turbidity in NTU (depth averaged)	7.8		8.2	

## APPENDIX C

### Calibration Details

## Summary of Calibration Certificate

### Noise Equipment

Model	Serial Number	Calibration Date	Expiry Date	Remark
B&K 2250-L	2741135	11 Nov 2014	11 Nov 2016 <sup>[1]</sup>	
B&K 2250-L	2741137	17 Oct 2014	17 Oct 2016 <sup>[1]</sup>	
B&K 4231 Calibrator	2309393	11 Nov 2014	11 Nov 2015 <sup>[1]</sup>	

### High Volume Sampler

Model	Sampler	Calibration Date	Expiry Date	Remark
Graseby-Andersen	694-0661	5 Jul 2014	5 Jan 2015 <sup>[2]</sup>	
Graseby-Andersen	894-0833	5 Jul 2014	5 Jan 2015 <sup>[2]</sup>	
Graseby-Andersen	994-0878	5 Jul 2014	5 Jan 2015 <sup>[2]</sup>	
Graseby-Andersen	1294-1104	5 Jul 2014	5 Jan 2015 <sup>[2]</sup>	
Graseby-Andersen	1294-1111	5 Jul 2014	5 Jan 2015 <sup>[2]</sup>	
Graseby-Andersen	694-0664	5 Jul 2014	5 Jan 2015 <sup>[2]</sup>	

### Water Quality Monitoring Equipment

Model	Serial Number	Calibration Date	Expiry Date	Remark
Multimeter for Dissolved Oxygen, pH, Temperature, Salinity and Turbidity				
YSI 6920V2	11F100014	21 Oct 2014	21 Jan 2015 <sup>[1]</sup>	



Note:

- [1] Calibration certificates refer to Appendix C of EM&A report - December 2014
- [2] Calibration certificates refer to Appendix C of EM&A report - August 2014



## APPENDIX D

Graphical Plots of Air Quality, Noise & Water Quality Impact Monitoring  
and Monitoring Results for Water Quality



### Graphical Plots for Air Quality Monitoring Results

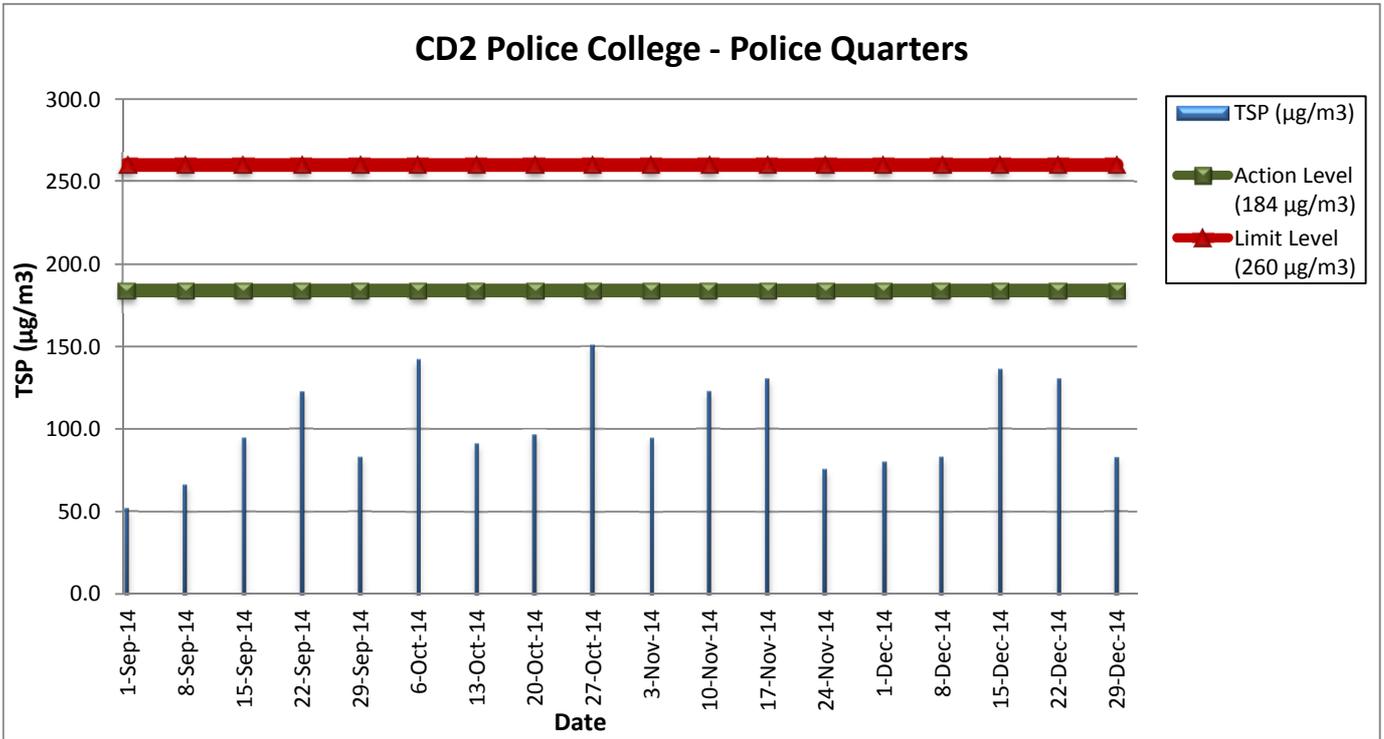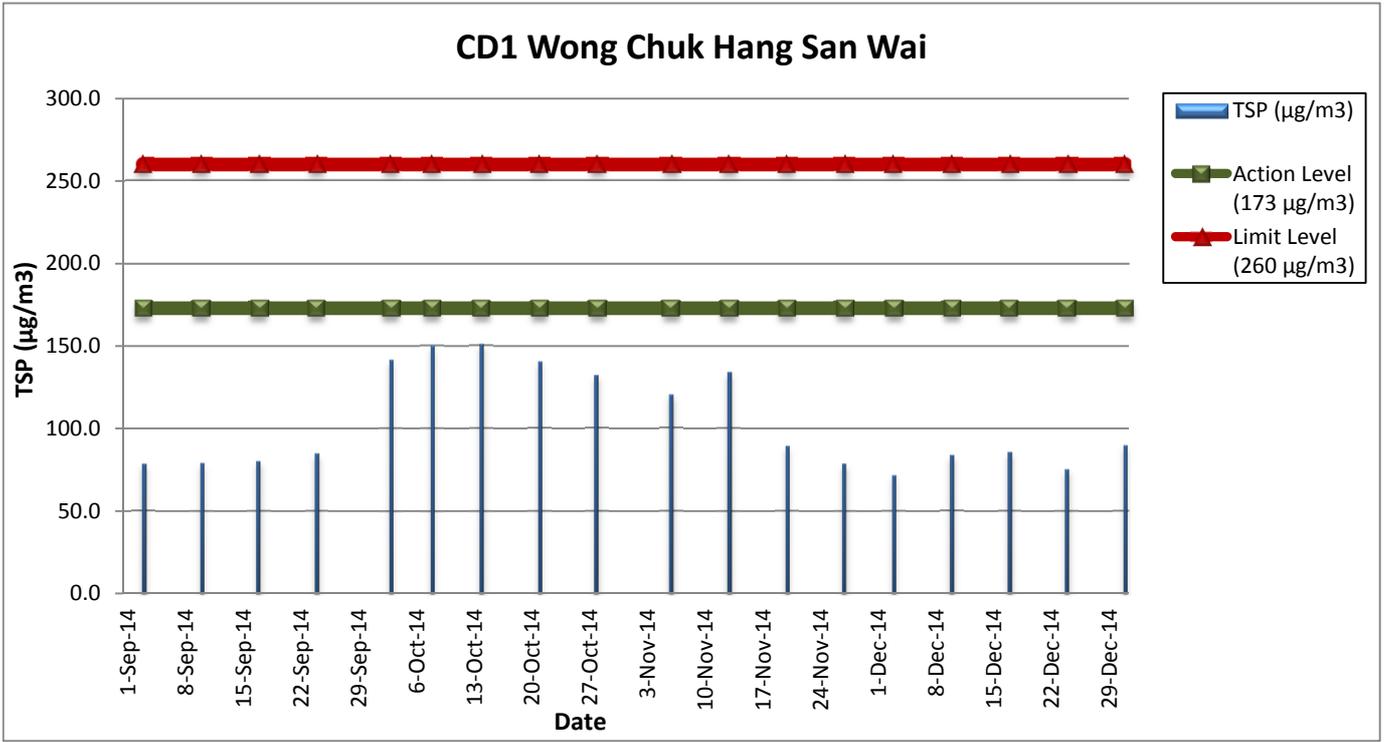

**Graphical Plots for Air Quality Monitoring Results**

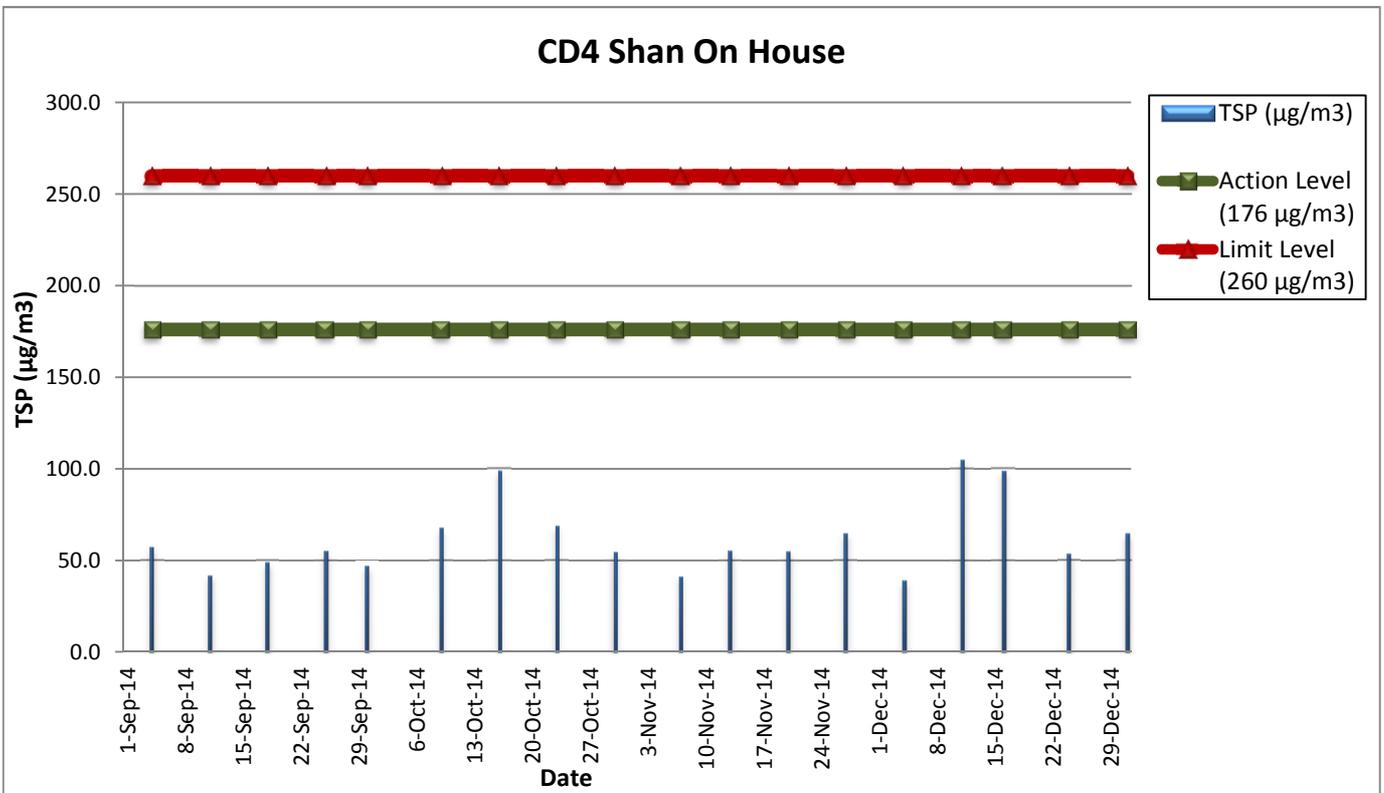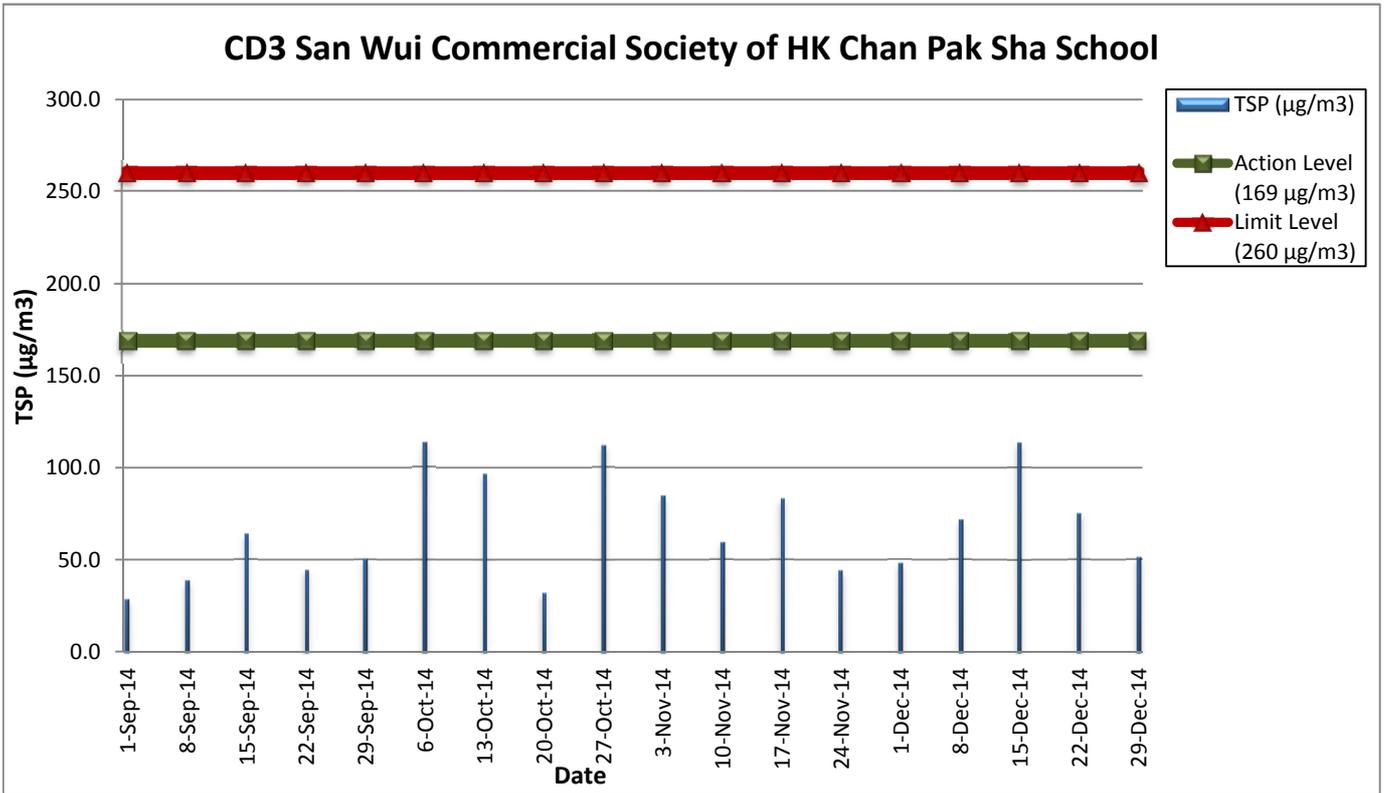


**Graphical Plots for Air Quality Monitoring Results**

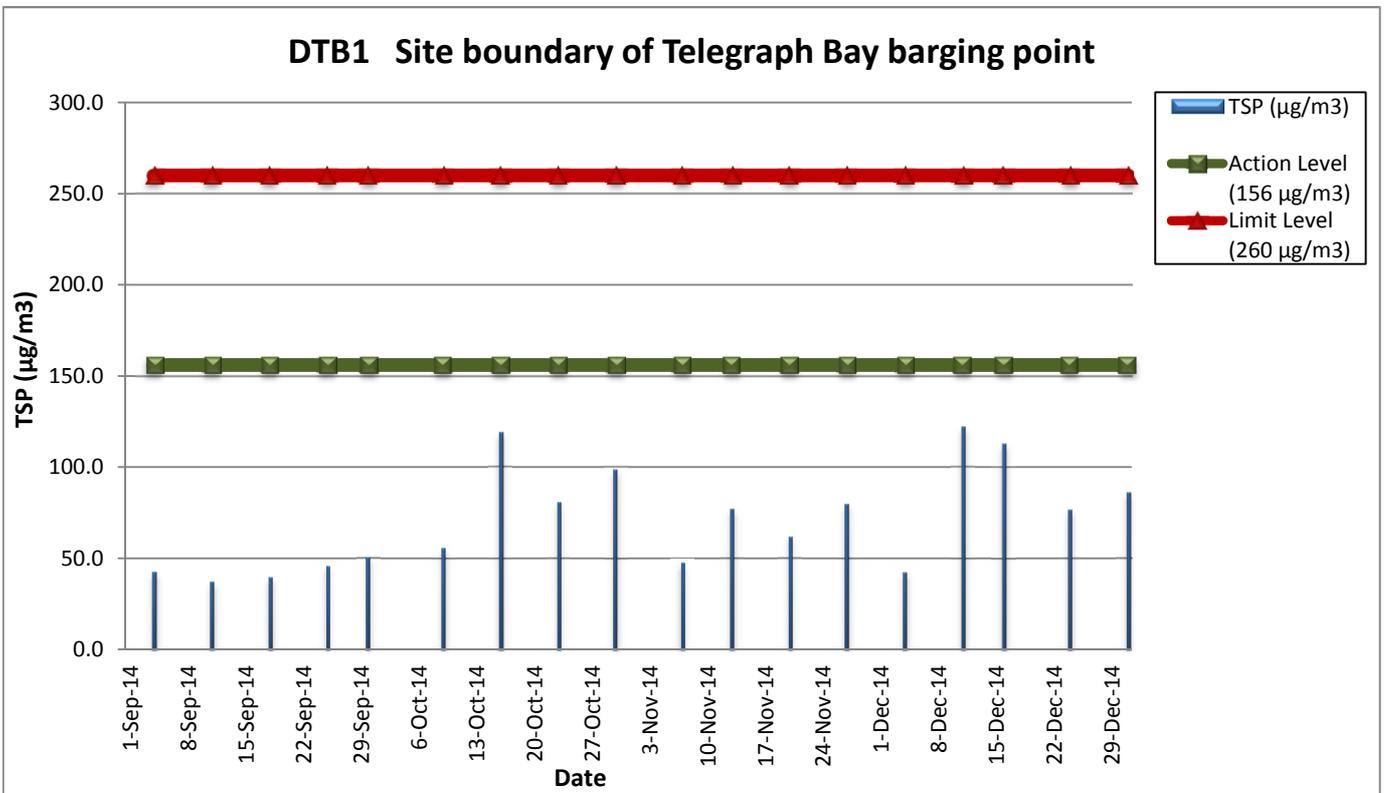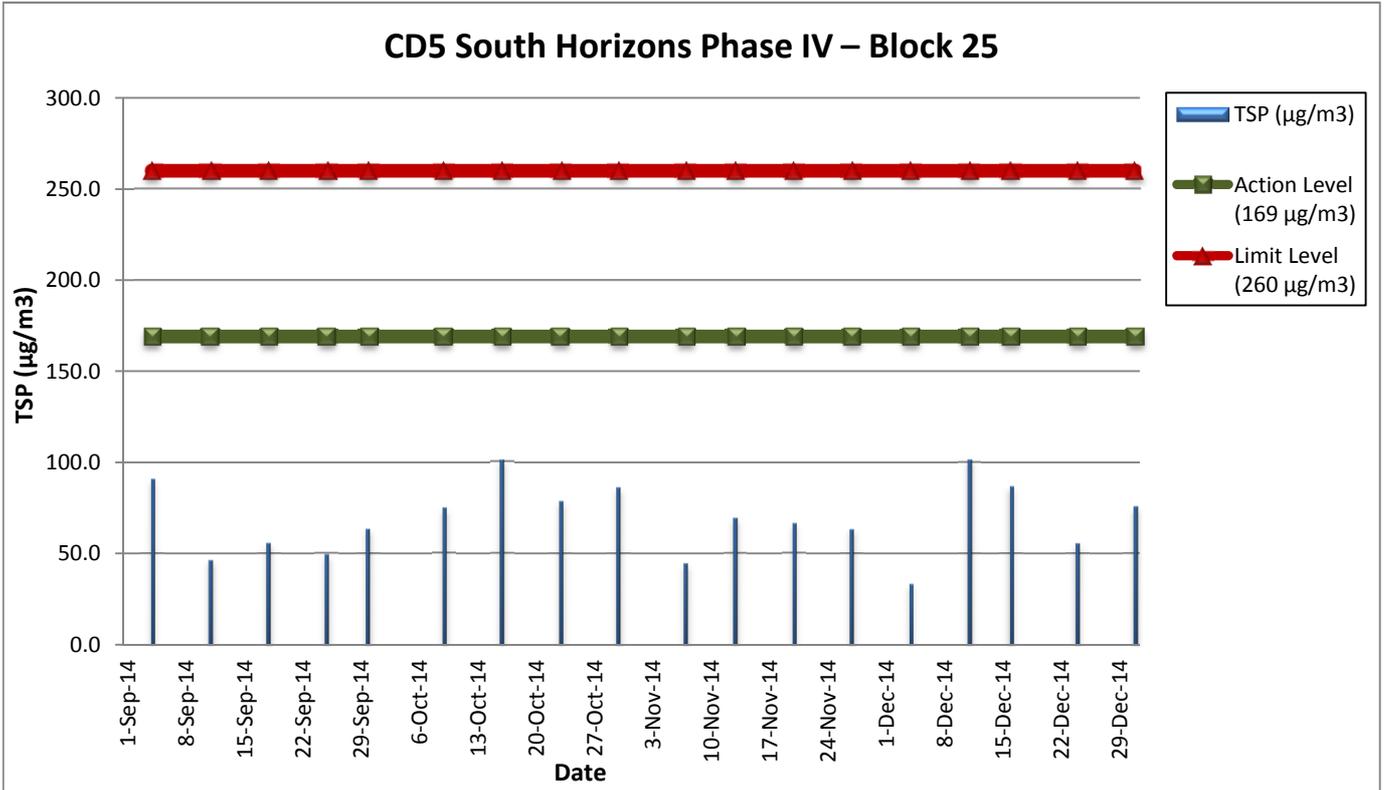


**Graphical Plots for Noise Monitoring Results**



**Noise Level at CN1 San Wui Commercial Society of  
HK Chan Pak Sha School (Educational Institution)**

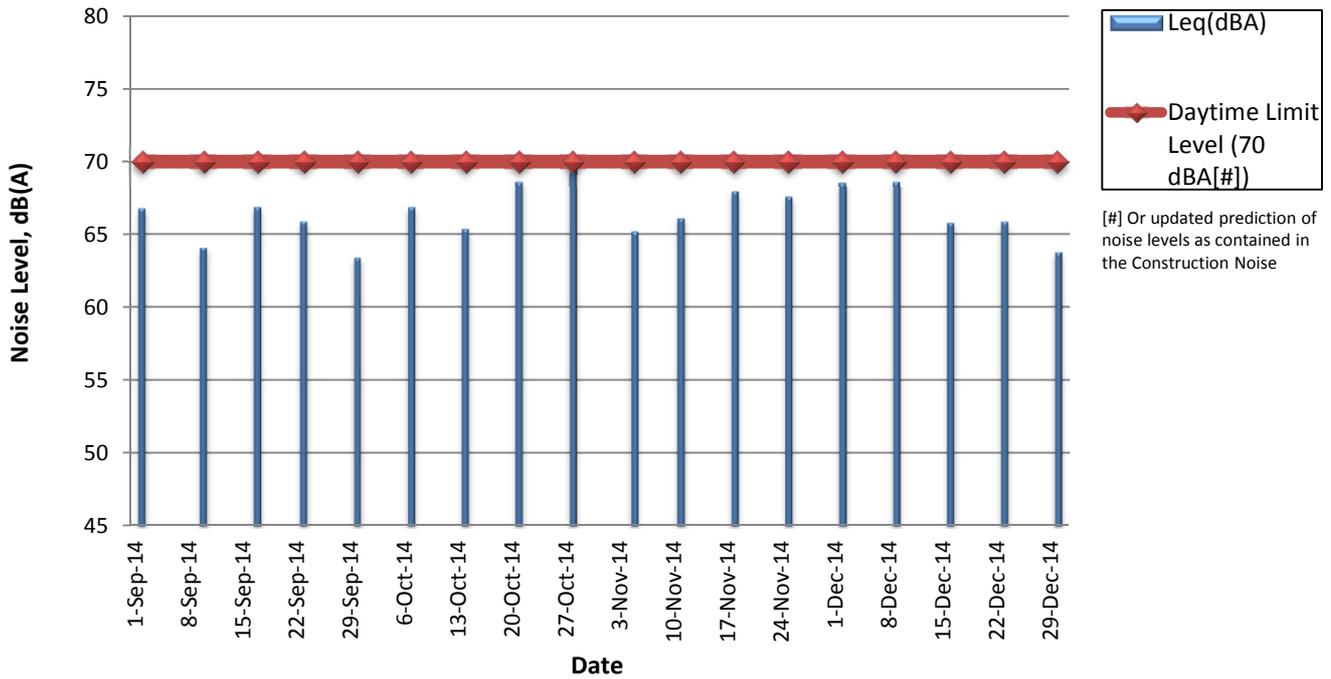

**CN2 Holy Spirit Seminary  
(Educational institution)**

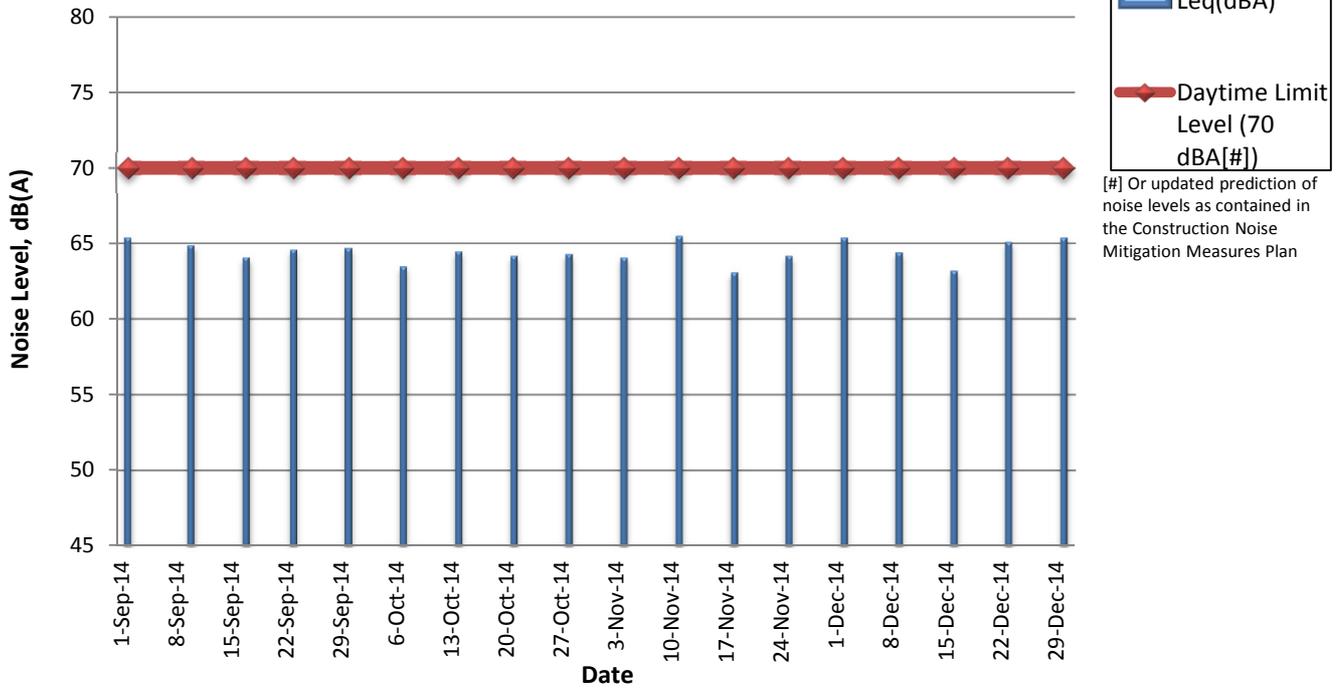


**Graphical Plots for Noise Monitoring Results**

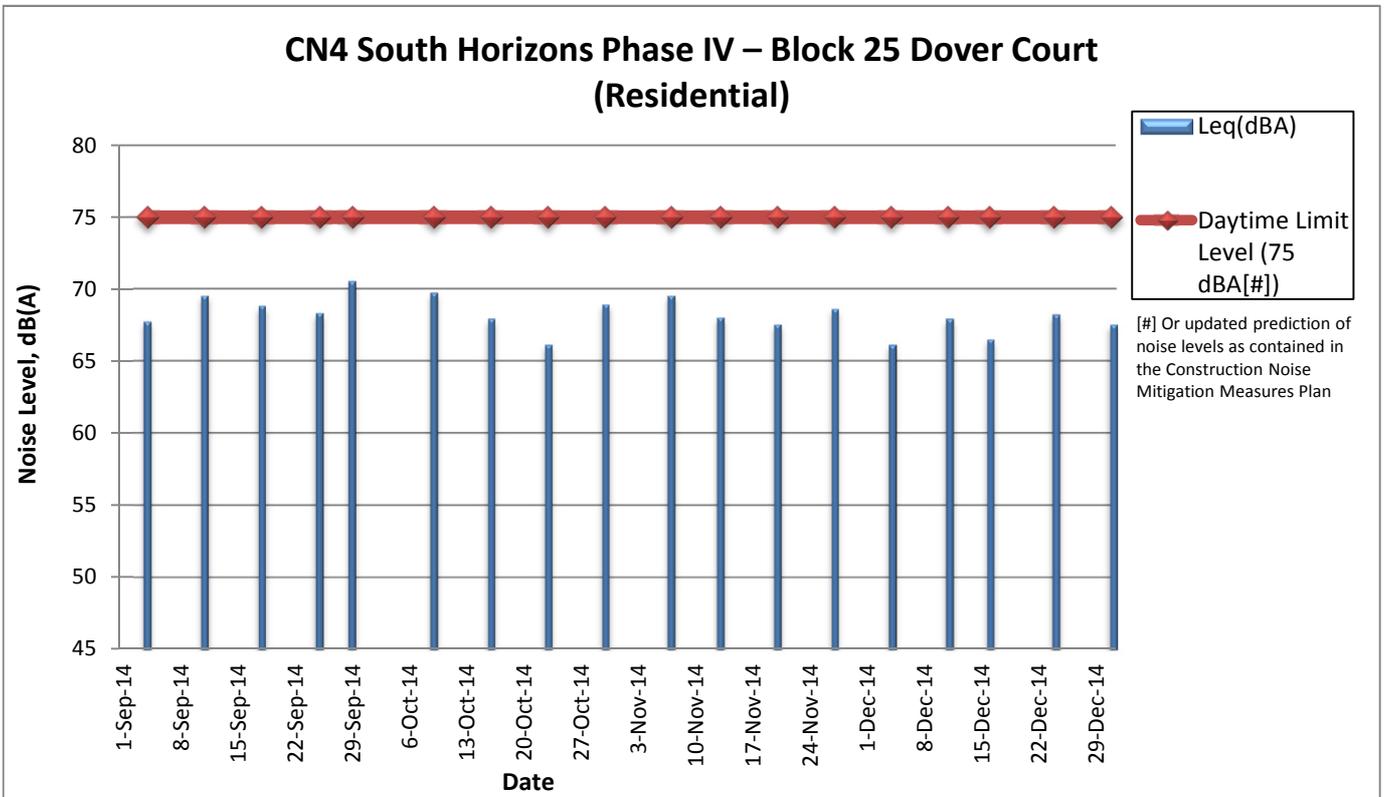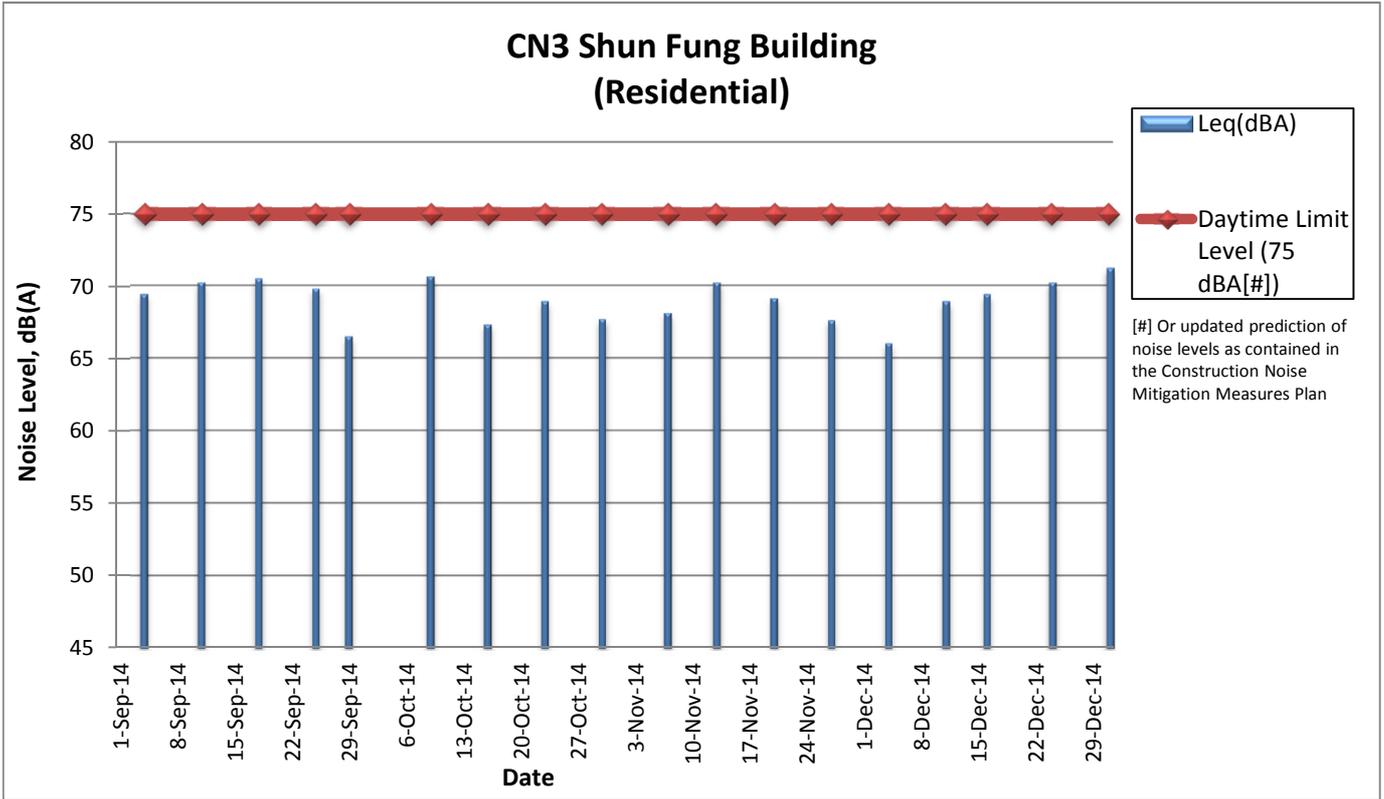


**Graphical Plots for Noise Monitoring Results**



**CN5 TWGHs Jockey Club Rehabilitation Complex Block A  
(Convalescent Home)**

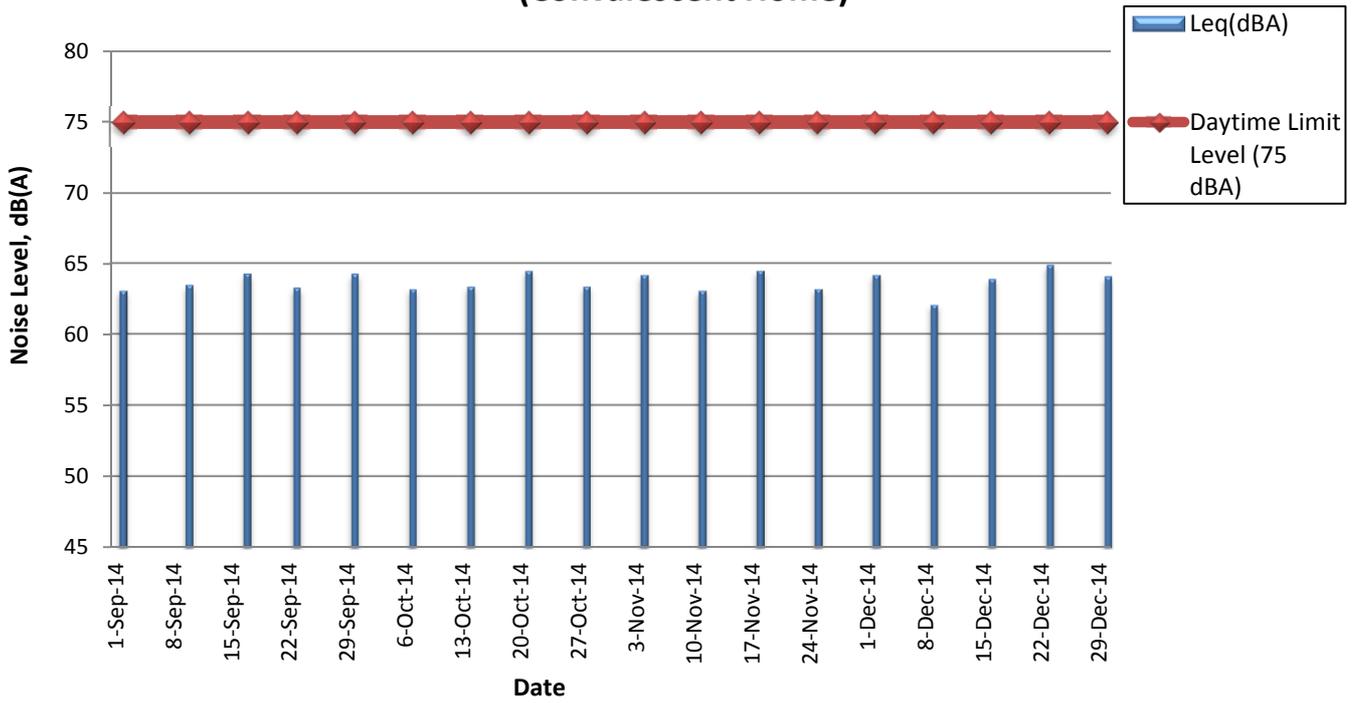



**NTB1 Outside Aegean Terrace**

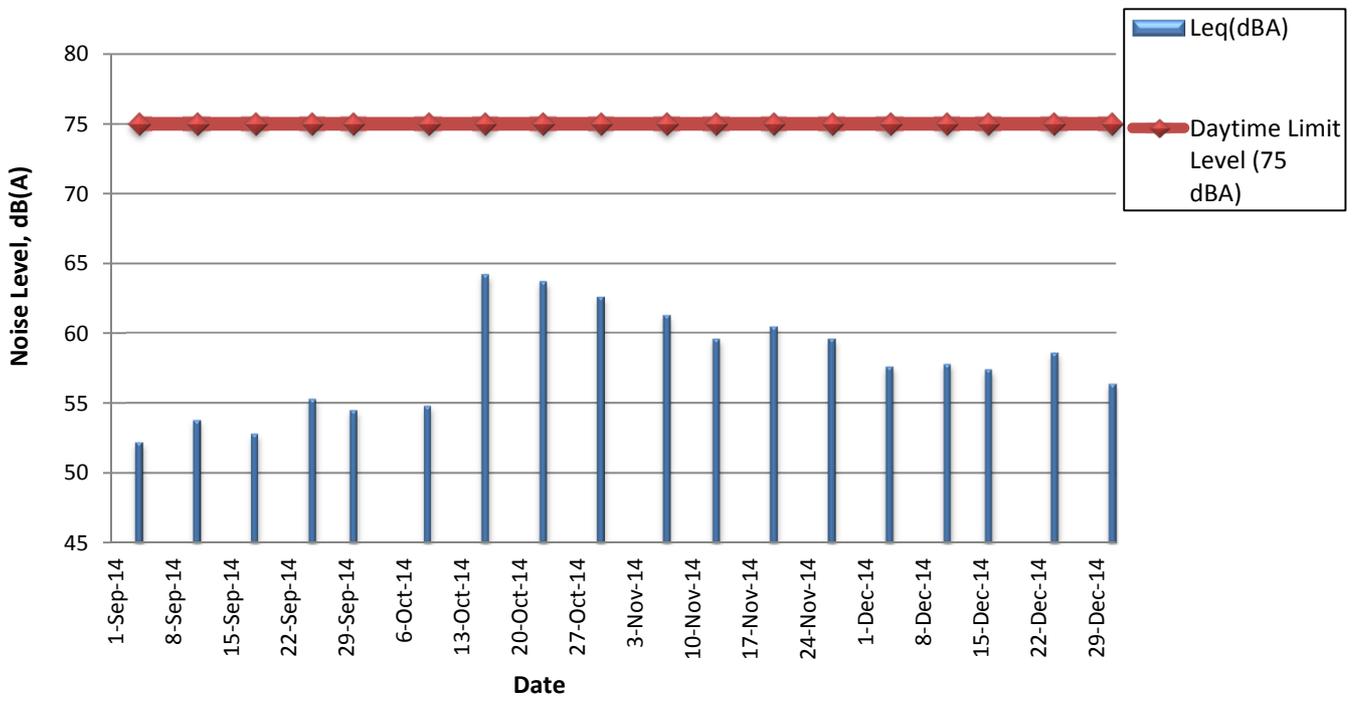



Graphical Plots of Water Quality Monitoring Results

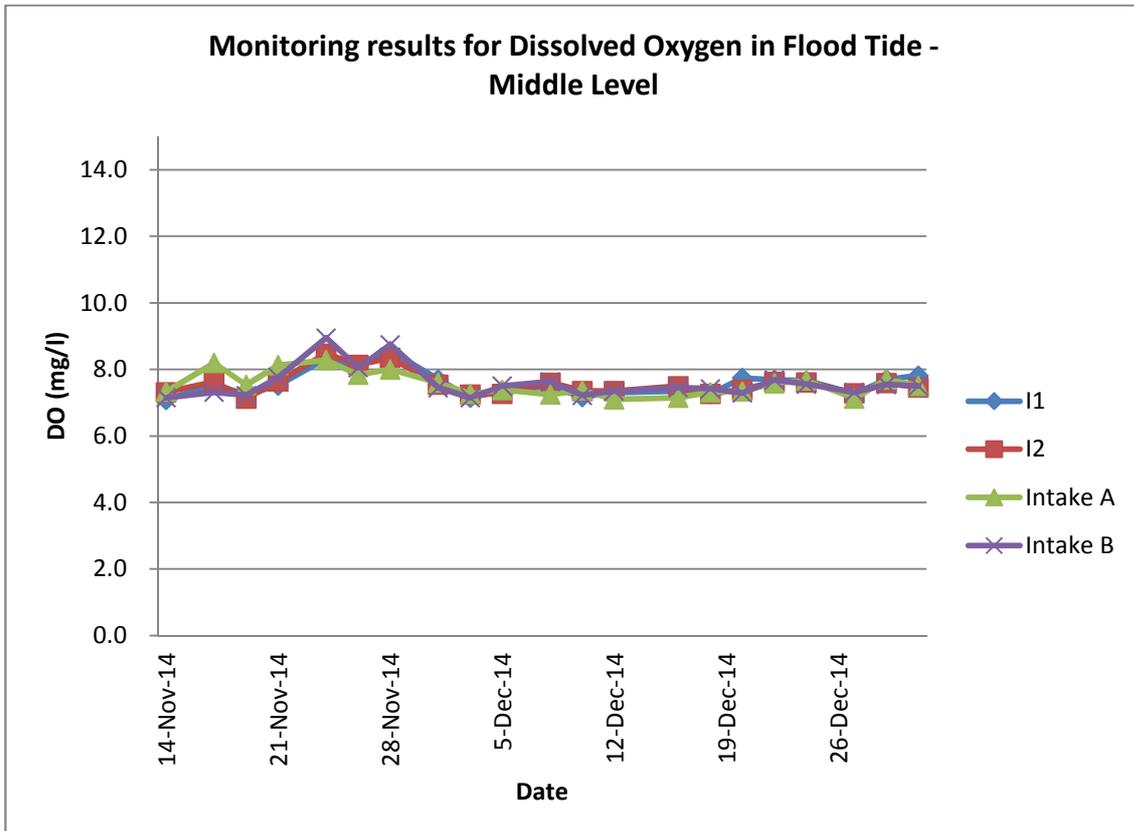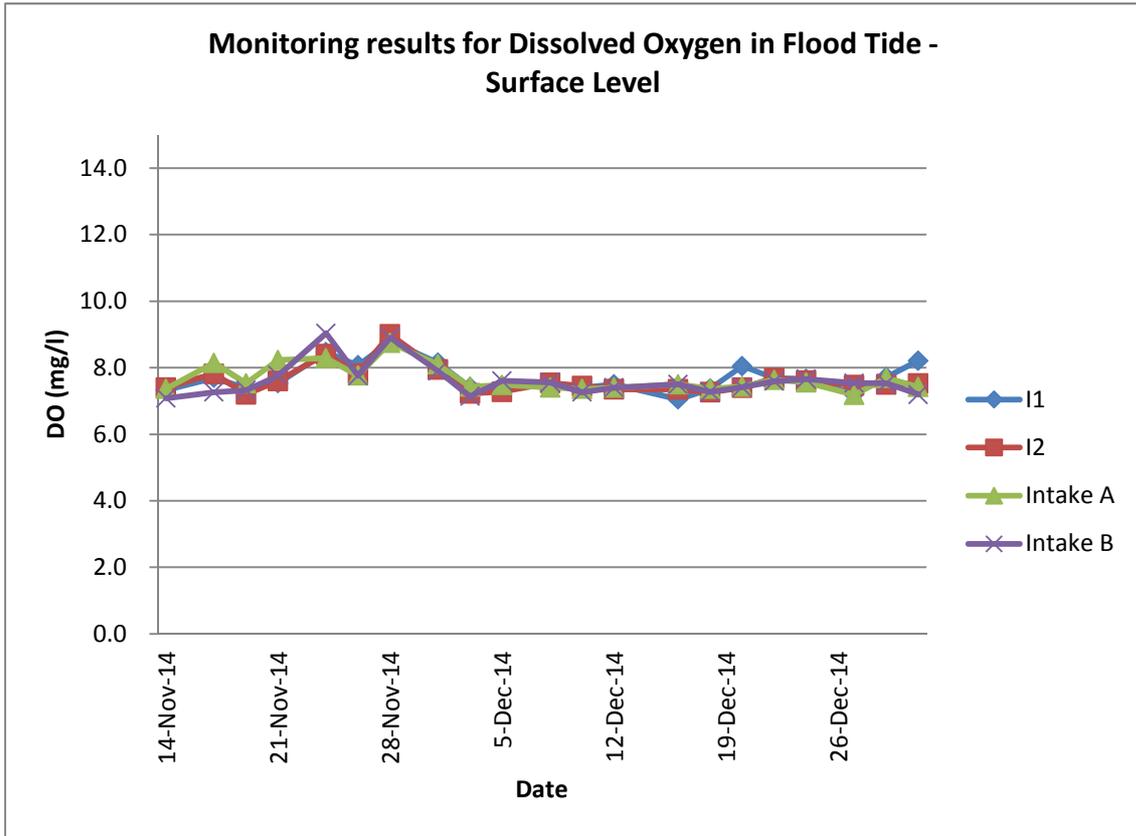



Graphical Plots of Water Quality Monitoring Results

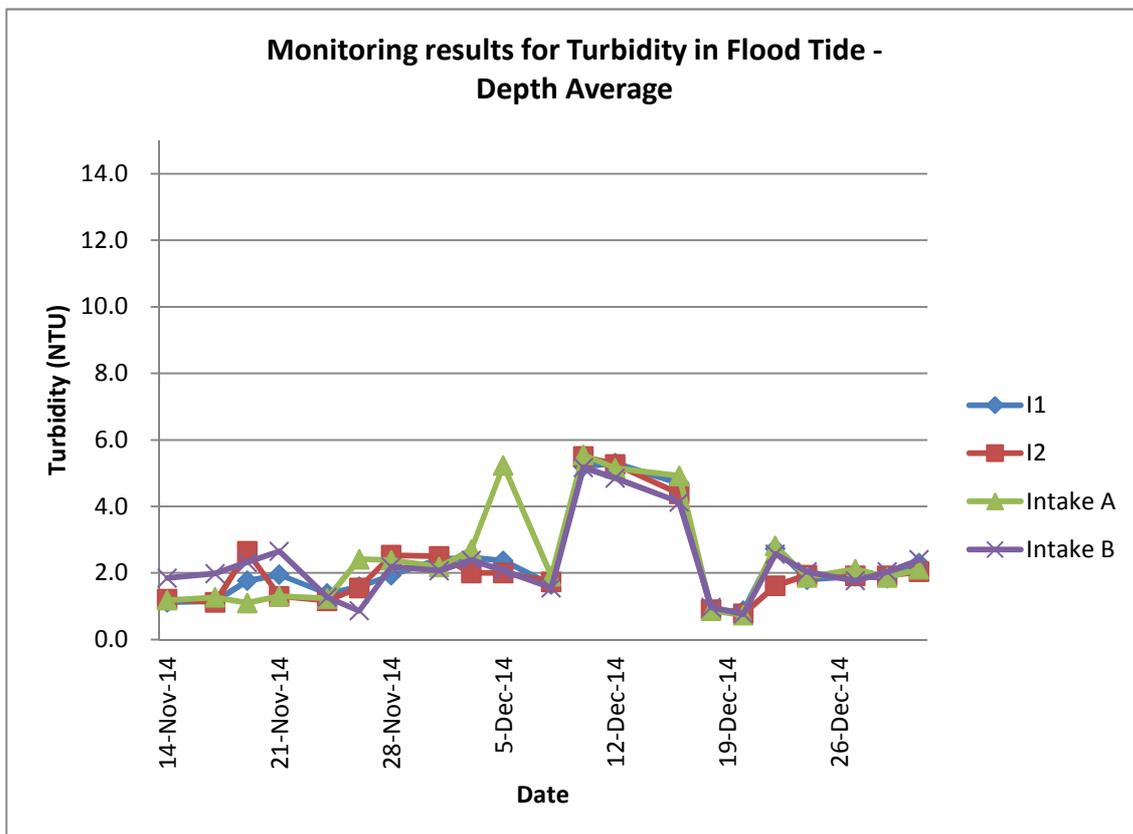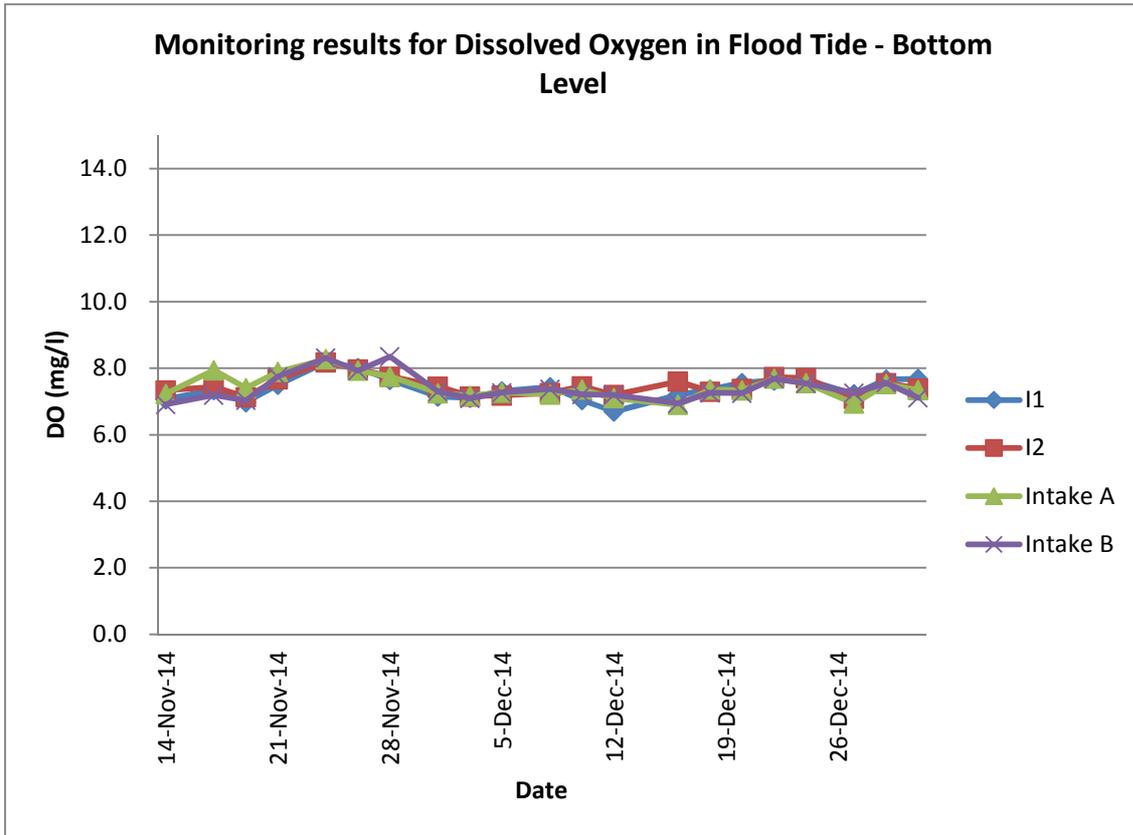



Graphical Plots of Water Quality Monitoring Results

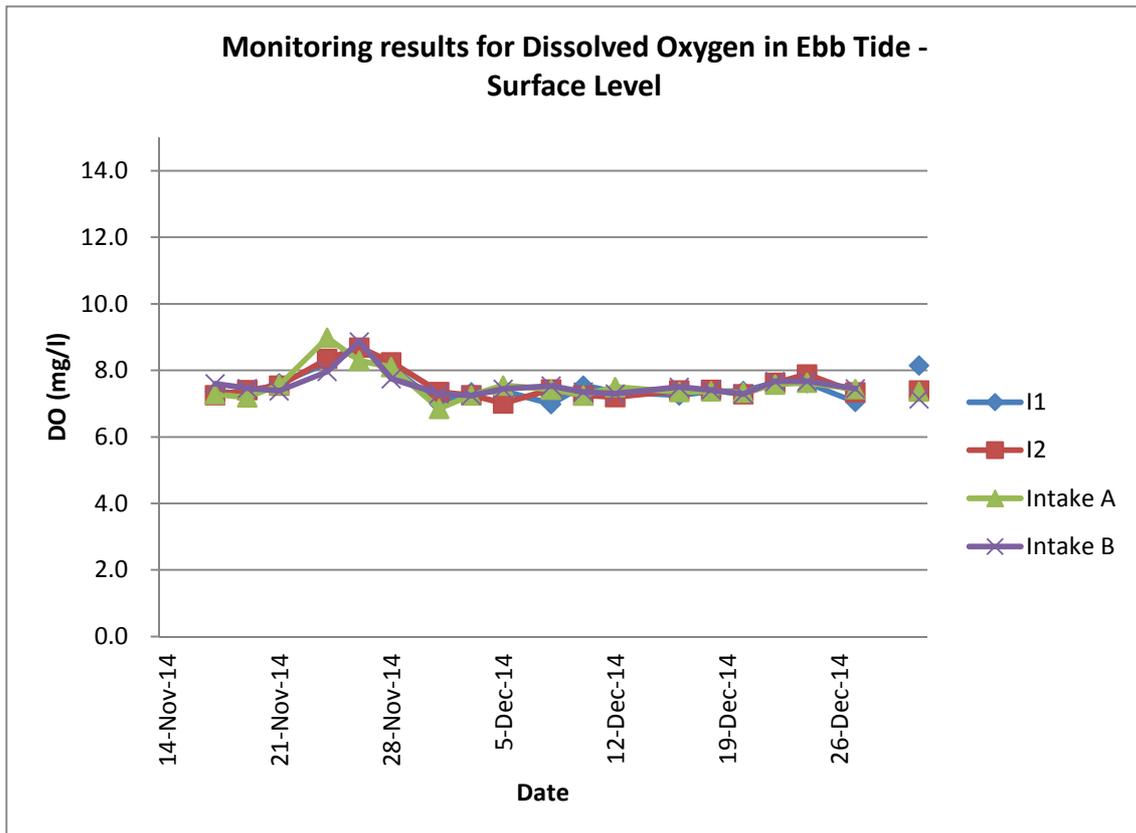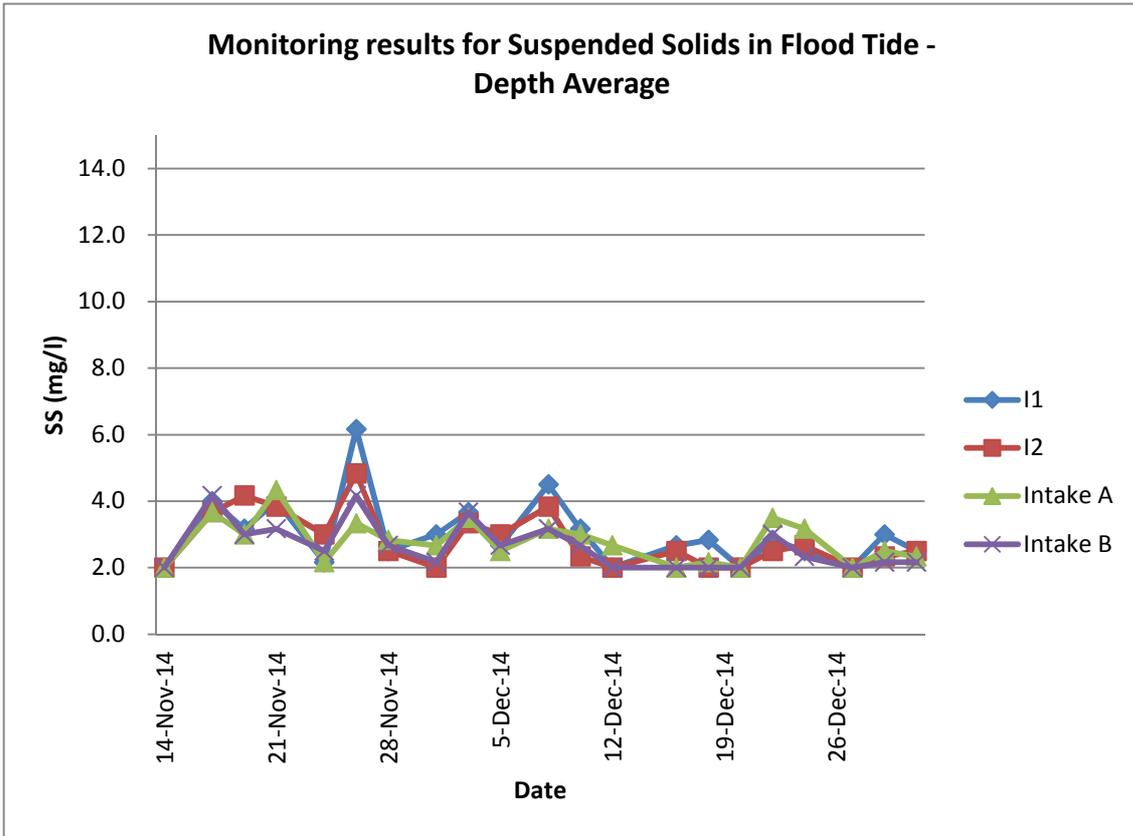

Graphical Plots of Water Quality Monitoring Results

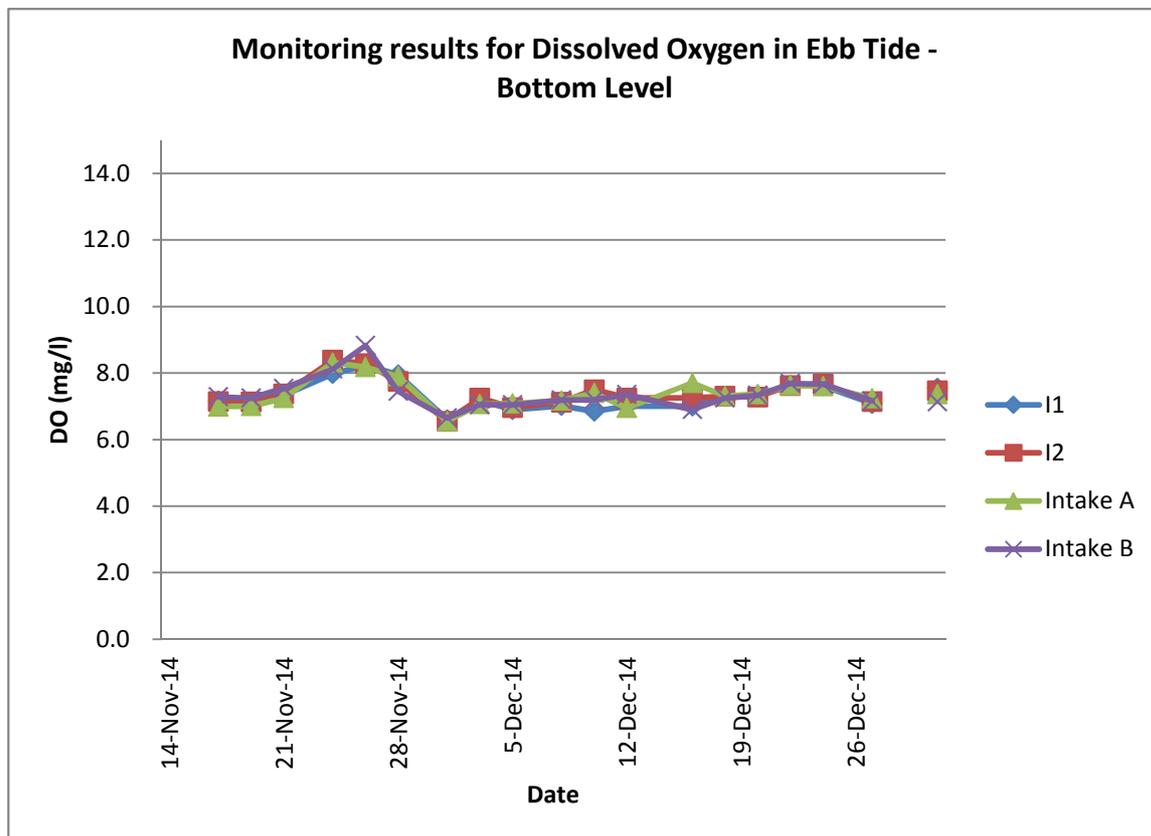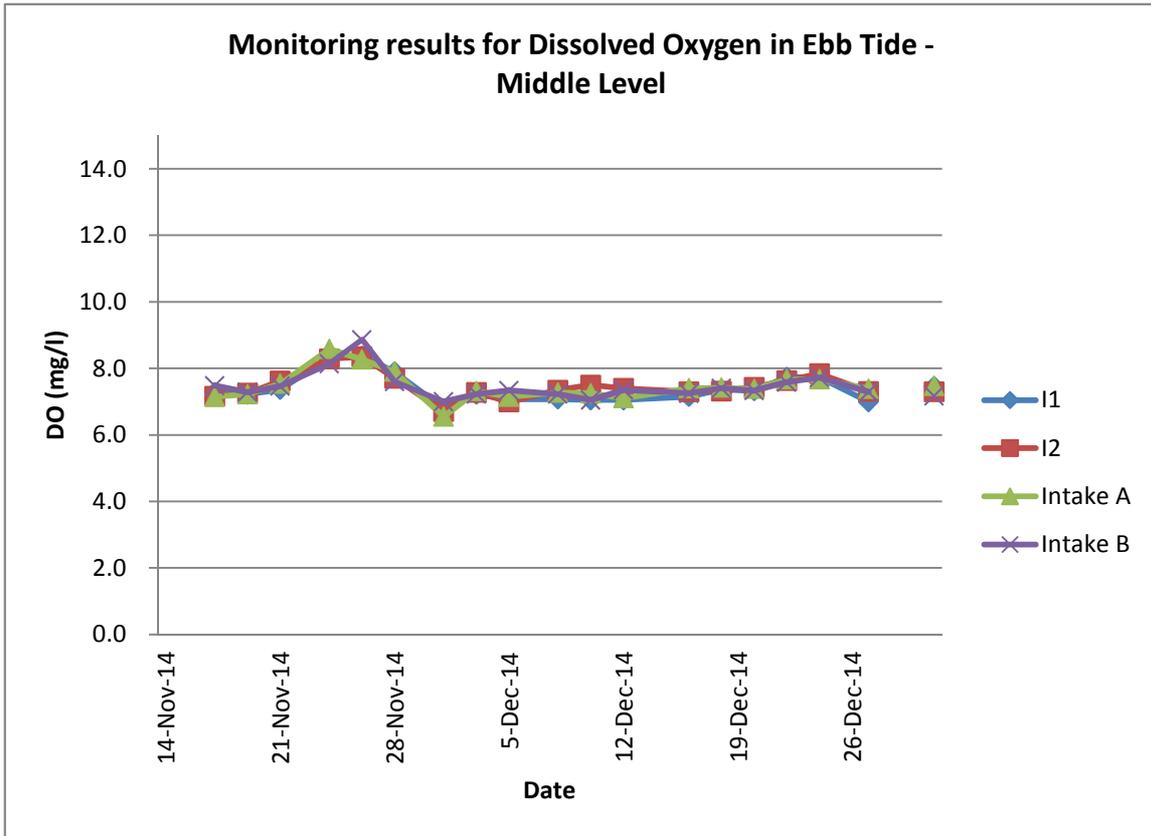

Graphical Plots of Water Quality Monitoring Results

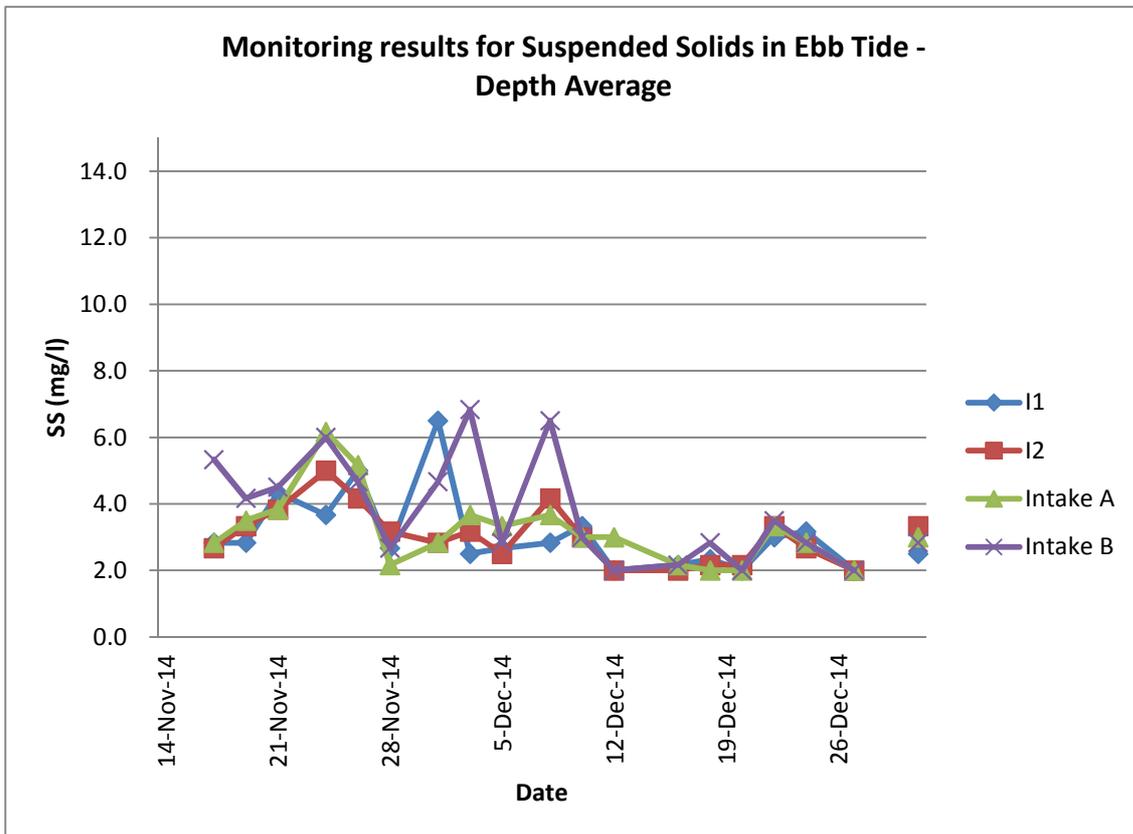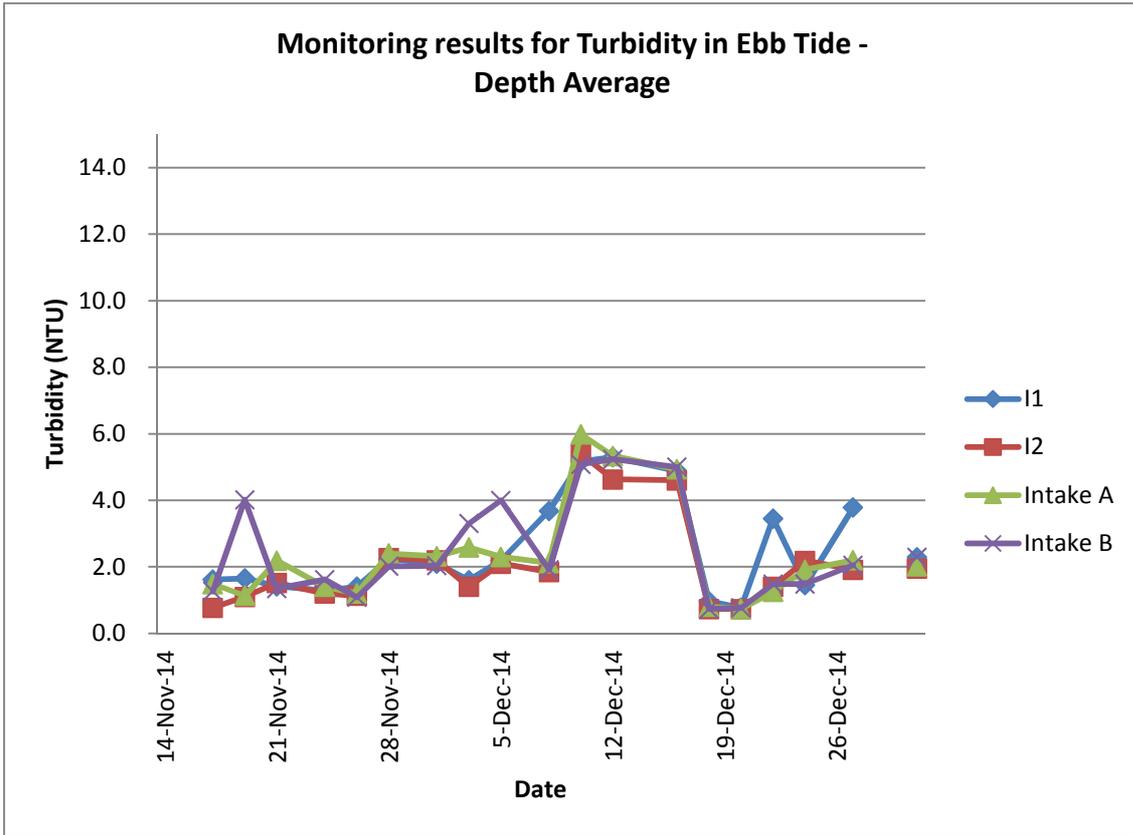

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 1-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)				Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**	
I1	14:06	13.9	Surface	23.6	23.7	23.7	8.5	8.4	8.4	33.4	33.4	33.4	8.1	8.2	8.2	115.0	116.9	116.0	2.1	2.2	2.2		2.0	3.0	2.5		
			Middle	23.8	23.7	23.8	8.5	8.4	8.4	33.5	33.5	33.5	7.7	7.7	7.7	110.9	111.4	111.2	2.5	2.5	2.5	2.4	3.0	3.0	3.0	3.0	
			Bottom	23.8	23.9	23.9	8.5	8.5	8.5	33.4	33.2	33.3	7.2	7.1	7.2	102.8	104.6	103.7	2.6	2.6	2.6		4.0	3.0	3.5		
I2	14:26	18.1	Surface	23.5	23.4	23.5	8.5	8.5	8.5	33.4	33.3	33.4	8.0	7.9	8.0	114.4	116.4	115.4	2.6	2.6	2.6		2.0	2.0	2.0		
			Middle	23.8	23.9	23.9	8.5	8.5	8.5	33.4	33.2	33.3	7.5	7.6	7.6	107.6	106.8	107.2	2.5	2.5	2.5	2.5	2.0	2.0	2.0	2.0	
			Bottom	23.8	23.8	23.8	8.5	8.5	8.5	33.4	33.7	33.6	7.4	7.5	7.5	105.5	104.8	105.2	2.4	2.4	2.4		2.0	2.0	2.0		
Intake A	14:47	9.6	Surface	23.6	23.6	23.6	8.5	8.4	8.4	33.4	33.1	33.3	8.1	8.1	8.1	115.2	115.6	115.4	2.1	2.2	2.2		2.0	3.0	2.5		
			Middle	23.8	23.7	23.8	8.5	8.4	8.4	33.4	33.3	33.4	7.7	7.5	7.6	110.6	108.7	109.7	2.1	2.1	2.1	2.2	2.0	3.0	2.5	2.7	
			Bottom	23.8	24.0	23.9	8.5	8.4	8.4	33.4	33.6	33.5	7.3	7.2	7.3	104.3	102.9	103.6	2.3	2.3	2.3		4.0	2.0	3.0		
Intake B	13:45	9.4	Surface	23.6	23.4	23.5	8.5	8.6	8.5	33.4	33.6	33.5	8.0	7.8	7.9	113.8	112.6	113.2	1.8	1.7	1.8		2.0	2.0	2.0		
			Middle	23.8	23.9	23.9	8.5	8.5	8.5	33.4	33.6	33.5	7.4	7.5	7.5	106.1	108.0	107.1	2.3	2.4	2.4	2.1	2.0	2.0	2.0	2.2	
			Bottom	23.8	23.6	23.7	8.5	8.5	8.5	33.4	33.6	33.5	7.3	7.3	7.3	104.2	104.2	104.2	2.1	2.1	2.1		2.0	3.0	2.5		
CF	15:08	18.3	Surface	23.5	23.6	23.6	8.5	8.6	8.5	33.5	33.2	33.4	7.9	7.7	7.8	112.3	112.0	112.2	1.2	1.2	1.2		4.0	4.0	4.0		
			Middle	23.8	23.6	23.7	8.5	8.4	8.4	33.4	33.2	33.3	7.6	7.5	7.6	108.6	108.5	108.6	1.3	1.3	1.3	1.3	4.0	4.0	4.0	4.5	
			Bottom	23.8	24.0	23.9	8.5	8.4	8.4	33.5	33.8	33.7	7.0	7.0	7.0	100.2	99.6	99.9	1.5	1.5	1.5		5.0	6.0	5.5		

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 1-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	07:00	24.1	Surface	23.9	24.1	24.0	8.5	8.6	8.5	33.3	33.2	33.3	7.2	7.3	7.3	103.2	101.8	102.5	1.4	1.4	1.4		4.0	3.0	3.5	
			Middle	23.8	23.9	23.9	8.5	8.4	8.4	33.5	33.3	33.4	6.9	7.1	7.0	99.6	100.1	99.9	1.6	1.7	1.7	1.4	4.0	5.0	4.5	4.5
			Bottom	23.8	23.6	23.7	8.5	8.6	8.5	33.5	33.3	33.4	6.9	6.9	6.9	98.4	97.8	98.1	1.3	1.2	1.3		5.0	6.0	5.5	
I1	07:43	13.5	Surface	23.8	24.0	23.9	8.5	8.4	8.4	33.4	33.4	33.4	7.0	7.0	7.0	100.3	98.6	99.5	2.3	2.3	2.3		4.0	5.0	4.5	
			Middle	23.9	23.8	23.9	8.5	8.4	8.4	33.3	33.6	33.5	6.8	6.8	6.8	98.0	98.9	98.5	2.0	1.9	2.0	2.1	8.0	7.0	7.5	6.5
			Bottom	23.8	23.8	23.8	8.5	8.4	8.4	33.4	33.6	33.5	6.6	6.6	6.6	94.3	93.8	94.1	2.1	2.0	2.1		8.0	7.0	7.5	
I2	08:03	18.1	Surface	23.9	23.9	23.9	8.5	8.4	8.4	33.4	33.6	33.5	7.3	7.4	7.4	104.1	104.4	104.3	2.1	2.1	2.1		2.0	2.0	2.0	
			Middle	23.9	24.0	24.0	8.4	8.5	8.5	33.3	33.2	33.3	6.7	6.7	6.7	96.0	97.5	96.8	2.4	2.4	2.4	2.2	2.0	3.0	2.5	2.8
			Bottom	23.9	24.1	24.0	8.5	8.4	8.4	33.3	33.0	33.2	6.5	6.6	6.6	93.8	92.3	93.1	2.1	2.1	2.1		4.0	4.0	4.0	
Intake A	08:24	9.2	Surface	23.9	23.8	23.9	8.5	8.4	8.4	33.4	33.2	33.3	6.9	6.8	6.9	99.3	97.4	98.4	2.3	2.4	2.4		2.0	2.0	2.0	
			Middle	23.9	23.7	23.8	8.5	8.5	8.5	33.4	33.1	33.3	6.6	6.5	6.6	94.7	96.4	95.6	2.4	2.5	2.5	2.3	2.0	3.0	2.5	2.8
			Bottom	23.9	23.8	23.9	8.5	8.4	8.4	33.4	33.6	33.5	6.6	6.5	6.6	95.2	94.4	94.8	2.1	2.2	2.2		4.0	4.0	4.0	
Intake B	07:22	9.4	Surface	23.9	23.9	23.9	8.5	8.5	8.5	33.2	32.9	33.1	7.3	7.3	7.3	105.2	104.5	104.9	2.1	2.2	2.2		4.0	3.0	3.5	
			Middle	23.8	23.7	23.8	8.5	8.4	8.4	33.4	33.2	33.3	7.0	7.0	7.0	101.0	102.1	101.6	2.2	2.1	2.2	2.0	5.0	5.0	5.0	4.7
			Bottom	23.8	23.7	23.8	8.5	8.4	8.4	33.4	33.4	33.4	6.6	6.7	6.7	94.5	95.2	94.9	1.8	1.8	1.8		6.0	5.0	5.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 3-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	15:21	14.0	Surface	22.8	22.9	22.8	8.4	8.5	8.5	33.7	33.8	33.7	7.3	7.5	7.4	103.3	102.9	103.1	3.8	3.7	3.8		3.0	2.0	2.5	
			Middle	22.8	22.9	22.9	8.4	8.5	8.5	33.6	33.5	33.6	7.2	7.1	7.2	101.6	100.0	100.8	1.8	1.9	1.9	2.5	4.0	3.0	3.5	3.7
			Bottom	22.8	22.6	22.7	8.4	8.4	8.4	33.6	33.4	33.5	7.1	7.1	7.1	100.4	102.3	101.4	1.8	1.8	1.8		5.0	5.0	5.0	
I2	15:41	18.1	Surface	22.8	22.9	22.8	8.5	8.4	8.4	33.7	33.7	33.7	7.3	7.2	7.2	102.3	102.1	102.2	1.4	1.4	1.4		3.0	2.0	2.5	
			Middle	22.8	22.8	22.8	8.5	8.5	8.5	33.6	33.7	33.6	7.2	7.3	7.3	101.5	103.4	102.5	2.1	2.2	2.2	2.0	3.0	4.0	3.5	3.3
			Bottom	22.8	22.7	22.8	8.4	8.5	8.5	33.6	33.4	33.5	7.1	7.2	7.2	100.3	101.3	100.8	2.4	2.5	2.5		4.0	4.0	4.0	
Intake A	16:02	9.6	Surface	22.8	22.7	22.7	8.4	8.4	8.4	33.6	33.9	33.8	7.4	7.5	7.4	103.8	104.3	104.1	3.7	3.7	3.7		3.0	3.0	3.0	
			Middle	22.8	22.7	22.7	8.4	8.5	8.5	33.6	33.9	33.7	7.2	7.3	7.3	102.0	103.9	103.0	2.3	2.3	2.3	2.7	3.0	3.0	3.0	3.5
			Bottom	22.8	22.8	22.8	8.4	8.3	8.3	33.6	33.3	33.4	7.2	7.2	7.2	100.8	99.4	100.1	2.1	2.1	2.1		5.0	4.0	4.5	
Intake B	15:00	9.4	Surface	22.8	22.7	22.7	8.4	8.3	8.4	33.7	33.6	33.6	7.2	7.1	7.1	101.2	103.1	102.2	1.4	1.4	1.4		3.0	3.0	3.0	
			Middle	22.8	22.6	22.7	8.4	8.4	8.4	33.6	33.9	33.8	7.1	7.2	7.2	100.0	101.8	100.9	2.1	2.1	2.1	2.4	4.0	3.0	3.5	3.7
			Bottom	22.8	22.7	22.8	8.4	8.5	8.5	33.6	33.8	33.7	7.1	7.1	7.1	100.0	101.4	100.7	3.6	3.7	3.7		5.0	4.0	4.5	
CF	16:23	18.2	Surface	22.8	22.6	22.7	8.4	8.5	8.5	33.8	33.5	33.6	7.3	7.3	7.3	102.2	100.6	101.4	1.1	1.1	1.1		2.0	2.0	2.0	
			Middle	22.8	22.8	22.8	8.4	8.4	8.4	33.7	33.6	33.6	7.2	7.3	7.2	100.8	99.8	100.3	1.2	1.2	1.2	1.3	2.0	2.0	2.0	2.2
			Bottom	22.8	22.7	22.7	8.4	8.5	8.5	33.6	33.6	33.6	7.1	7.2	7.1	99.9	98.6	99.3	1.5	1.5	1.5		3.0	2.0	2.5	

Remark or Observation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 3-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	09:00	24.0	Surface	22.8	22.7	22.7	8.3	8.3	8.3	33.8	34.0	33.9	7.1	7.1	7.1	100.0	98.6	99.3	1.5	1.4	1.5		4.0	4.0	4.0	
			Middle	22.8	22.9	22.8	8.3	8.4	8.4	33.8	33.7	33.7	7.1	7.2	7.1	99.9	98.2	99.1	1.2	1.2	1.2	1.4	4.0	4.0	4.0	4.0
			Bottom	22.8	22.7	22.8	8.4	8.5	8.4	33.8	33.8	33.8	7.1	7.2	7.2	100.4	98.8	99.6	1.5	1.5	1.5		4.0	4.0	4.0	
I1	09:43	13.5	Surface	22.8	22.7	22.8	8.4	8.4	8.4	33.8	33.6	33.7	7.4	7.3	7.3	104.1	101.9	103.0	1.2	1.2	1.2		2.0	2.0	2.0	
			Middle	22.8	23.0	22.9	8.4	8.4	8.4	33.8	34.0	33.9	7.2	7.2	7.2	102.0	102.2	102.1	2.0	2.0	2.0	1.6	2.0	3.0	2.5	2.5
			Bottom	22.8	22.8	22.8	8.4	8.4	8.4	33.8	33.8	33.8	7.2	7.2	7.2	101.4	102.6	102.0	1.6	1.6	1.6		3.0	3.0	3.0	
I2	10:03	18.2	Surface	22.8	22.6	22.7	8.4	8.4	8.4	33.7	33.7	33.7	7.3	7.2	7.3	103.1	102.1	102.6	1.2	1.2	1.2		3.0	3.0	3.0	
			Middle	22.8	22.8	22.8	8.4	8.5	8.5	33.7	34.0	33.9	7.3	7.3	7.3	102.5	104.3	103.4	1.1	1.1	1.1	1.4	3.0	3.0	3.0	3.2
			Bottom	22.8	22.7	22.8	8.4	8.4	8.4	33.7	33.9	33.8	7.2	7.3	7.2	101.5	101.5	101.5	1.9	1.9	1.9		4.0	3.0	3.5	
Intake A	10:24	9.5	Surface	22.8	22.8	22.8	8.4	8.4	8.4	33.7	33.8	33.8	7.3	7.2	7.3	103.1	102.9	103.0	2.2	2.3	2.3		3.0	3.0	3.0	
			Middle	22.8	22.7	22.8	8.4	8.4	8.4	33.7	33.5	33.6	7.2	7.4	7.3	102.0	100.2	101.1	1.9	1.9	1.9	2.6	3.0	4.0	3.5	3.7
			Bottom	22.8	22.7	22.8	8.4	8.5	8.5	33.7	33.8	33.7	7.1	7.0	7.1	100.6	101.4	101.0	3.6	3.6	3.6		5.0	4.0	4.5	
Intake B	09:22	9.6	Surface	22.8	22.8	22.8	8.4	8.3	8.4	33.7	34.0	33.9	7.3	7.2	7.2	102.8	101.6	102.2	3.3	3.3	3.3		7.0	7.0	7.0	
			Middle	22.8	22.8	22.8	8.4	8.4	8.4	33.7	33.8	33.8	7.2	7.3	7.2	100.8	102.9	101.9	3.5	3.6	3.6	3.3	7.0	7.0	7.0	6.8
			Bottom	22.8	22.9	22.9	8.4	8.5	8.5	33.7	33.7	33.7	7.1	7.0	7.1	100.2	101.2	100.7	3.1	3.0	3.1		6.0	7.0	6.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 5-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	16:51	14.2	Surface	22.1	21.9	22.0	8.5	8.5	8.5	33.5	33.5	33.5	7.5	7.4	7.5	104.4	104.3	104.4	1.4	1.4	1.4		2.0	2.0	2.0	
			Middle	22.1	22.0	22.1	8.4	8.5	8.5	33.5	33.6	33.5	7.3	7.4	7.4	101.9	103.1	102.5	3.2	3.3	3.3	2.4	2.0	3.0	2.5	2.7
			Bottom	22.1	21.9	22.0	8.4	8.4	8.4	33.5	33.3	33.4	7.2	7.4	7.3	100.5	99.8	100.2	2.5	2.4	2.5		3.0	4.0	3.5	
I2	17:11	18.1	Surface	22.1	22.1	22.1	8.4	8.5	8.5	33.5	33.3	33.4	7.3	7.3	7.3	101.1	102.5	101.8	2.0	2.1	2.1		3.0	3.0	3.0	
			Middle	22.1	22.2	22.2	8.4	8.4	8.4	33.5	33.6	33.6	7.2	7.3	7.3	100.8	99.0	99.9	1.9	1.9	1.9	2.0	3.0	3.0	3.0	3.0
			Bottom	22.1	22.2	22.2	8.4	8.4	8.4	33.5	33.3	33.4	7.2	7.2	7.2	99.8	100.6	100.2	2.0	2.1	2.1		3.0	3.0	3.0	
Intake A	17:32	9.2	Surface	22.1	22.1	22.1	8.4	8.4	8.4	33.5	33.3	33.4	7.5	7.5	7.5	103.7	101.5	102.6	1.5	1.6	1.6		3.0	3.0	3.0	
			Middle	22.1	21.9	22.0	8.4	8.5	8.5	33.5	33.7	33.6	7.4	7.4	7.4	102.6	100.5	101.6	1.6	1.6	1.6	5.2	2.0	2.0	2.0	2.5
			Bottom	22.1	22.3	22.2	8.4	8.4	8.4	33.5	33.7	33.6	7.2	7.3	7.3	100.8	101.9	101.4	12.7	12.4	12.6		3.0	2.0	2.5	
Intake B	16:30	9.5	Surface	22.1	22.2	22.1	8.4	8.5	8.5	33.6	33.7	33.7	7.6	7.6	7.6	105.9	107.4	106.7	1.9	2.0	2.0		3.0	3.0	3.0	
			Middle	22.1	22.0	22.1	8.4	8.5	8.5	33.6	33.5	33.5	7.4	7.6	7.5	103.2	104.4	103.8	2.0	2.0	2.0	2.1	3.0	3.0	3.0	2.7
			Bottom	22.1	22.0	22.1	8.5	8.5	8.5	33.5	33.7	33.6	7.2	7.3	7.3	100.9	101.6	101.3	2.3	2.2	2.3		2.0	2.0	2.0	
CF	17:53	18.1	Surface	22.1	21.9	22.0	8.4	8.5	8.5	33.7	33.9	33.8	7.5	7.3	7.4	104.2	102.2	103.2	2.4	2.5	2.5		3.0	4.0	3.5	
			Middle	22.1	22.2	22.2	8.4	8.5	8.5	33.5	33.8	33.7	7.3	7.2	7.3	102.0	100.5	101.3	1.8	1.7	1.8	2.0	3.0	3.0	3.0	2.8
			Bottom	22.1	22.1	22.1	8.5	8.4	8.4	33.5	33.6	33.5	7.3	7.1	7.2	100.9	99.7	100.3	1.7	1.7	1.7		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 5-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)							
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**				
CE	10:45	24.0	Surface	22.1	22.0	22.1	8.4	8.3	8.3	33.9	34.2	34.1	7.3	7.2	7.2	101.7	103.0	102.4	1.6	1.6	1.6					3.0	4.0	3.5		
			Middle	22.1	22.0	22.1	8.4	8.5	8.4	33.9	34.0	33.9	7.2	7.1	7.1	100.1	99.8	100.0	2.0	2.1	2.1	2.0					4.0	3.0	3.5	3.2
			Bottom	22.1	22.0	22.1	8.4	8.5	8.5	33.9	34.2	34.0	7.1	7.1	7.1	99.1	99.6	99.4	2.2	2.3	2.3					2.0	3.0	2.5		
I1	11:28	13.5	Surface	22.1	22.0	22.0	8.4	8.5	8.5	33.8	34.0	33.9	7.5	7.3	7.4	104.0	103.3	103.7	2.0	2.0	2.0					3.0	2.0	2.5		
			Middle	22.1	21.9	22.0	8.4	8.4	8.4	33.8	33.7	33.8	7.2	7.0	7.1	99.8	101.3	100.6	2.3	2.3	2.3	2.2					3.0	3.0	3.0	2.7
			Bottom	22.1	22.1	22.1	8.4	8.3	8.4	33.8	33.7	33.8	7.0	6.8	6.9	97.4	98.9	98.2	2.2	2.3	2.3					3.0	2.0	2.5		
I2	11:48	17.9	Surface	22.1	22.2	22.1	8.4	8.3	8.4	33.8	34.1	34.0	7.0	7.0	7.0	97.8	98.4	98.1	2.1	2.0	2.1					4.0	2.0	3.0		
			Middle	22.1	22.2	22.1	8.4	8.4	8.4	33.8	33.8	33.8	7.0	7.0	7.0	97.3	98.3	97.8	2.1	2.1	2.1	2.1					2.0	2.0	2.0	2.5
			Bottom	22.1	22.0	22.0	8.4	8.4	8.4	33.8	33.9	33.9	6.9	7.0	7.0	96.6	96.3	96.5	2.2	2.1	2.2					2.0	3.0	2.5		
Intake A	12:09	9.5	Surface	22.1	22.0	22.0	8.4	8.4	8.4	33.8	33.8	33.8	7.5	7.6	7.6	104.5	104.7	104.6	2.7	2.6	2.7					3.0	3.0	3.0		
			Middle	22.1	22.3	22.2	8.4	8.5	8.5	33.8	34.1	34.0	7.2	7.1	7.1	100.3	100.8	100.6	2.1	2.0	2.1	2.3					3.0	3.0	3.0	3.3
			Bottom	22.1	22.2	22.2	8.4	8.4	8.4	33.8	33.6	33.7	7.1	7.1	7.1	98.6	98.4	98.5	2.2	2.2	2.2					5.0	3.0	4.0		
Intake B	11:07	9.6	Surface	22.1	22.0	22.0	8.4	8.5	8.5	33.8	33.7	33.7	7.5	7.4	7.4	104.4	102.4	103.4	4.4	4.5	4.5					3.0	3.0	3.0		
			Middle	22.1	21.9	22.0	8.4	8.4	8.4	33.8	33.7	33.8	7.3	7.4	7.3	101.3	101.5	101.4	2.2	2.2	2.2	4.0					3.0	2.0	2.5	2.8
			Bottom	22.1	22.0	22.0	8.4	8.4	8.4	33.8	34.0	33.9	7.1	7.0	7.0	98.8	96.9	97.9	5.3	5.4	5.4					3.0	3.0	3.0		

Remark or Obsevation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 8-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	08:02	14.0	Surface	21.6	21.6	21.6	8.5	8.4	8.4	33.6	33.3	33.5	7.5	7.4	7.4	102.8	102.9	102.9	1.6	1.5	1.6		4.0	4.0	4.0	
			Middle	21.6	21.7	21.6	8.5	8.4	8.4	33.6	33.4	33.5	7.5	7.5	7.5	103.3	104.6	104.0	1.7	1.7	1.7	1.7	4.0	5.0	4.5	4.5
			Bottom	21.5	21.5	21.5	8.5	8.5	8.5	33.6	33.6	33.6	7.5	7.4	7.4	102.9	102.9	102.9	1.7	1.7	1.7		5.0	5.0	5.0	
I2	07:41	18.0	Surface	21.5	21.4	21.5	8.5	8.4	8.4	33.6	33.4	33.5	7.6	7.5	7.5	104.6	105.9	105.3	1.5	1.5	1.5		3.0	4.0	3.5	
			Middle	21.5	21.6	21.5	8.5	8.4	8.4	33.6	33.7	33.7	7.5	7.7	7.6	103.4	103.9	103.7	1.6	1.7	1.7	1.7	4.0	4.0	4.0	3.8
			Bottom	21.5	21.7	21.6	8.5	8.4	8.4	33.6	33.8	33.7	7.3	7.2	7.3	100.7	100.5	100.6	2.1	2.0	2.1		4.0	4.0	4.0	
Intake A	07:20	9.5	Surface	21.5	21.5	21.5	8.4	8.4	8.4	33.6	33.5	33.5	7.4	7.4	7.4	102.1	100.7	101.4	2.1	2.1	2.1		3.0	2.0	2.5	
			Middle	21.5	21.7	21.6	8.4	8.3	8.4	33.6	33.5	33.5	7.3	7.2	7.2	100.4	99.5	100.0	1.9	1.8	1.9	1.9	3.0	3.0	3.0	3.2
			Bottom	21.5	21.3	21.4	8.5	8.5	8.5	33.6	33.3	33.4	7.2	7.2	7.2	99.3	99.8	99.6	1.7	1.8	1.8		4.0	4.0	4.0	
Intake B	08:22	9.6	Surface	21.6	21.5	21.6	8.5	8.4	8.4	33.6	33.8	33.7	7.6	7.5	7.6	105.2	106.7	106.0	1.5	1.4	1.5		3.0	3.0	3.0	
			Middle	21.5	21.7	21.6	8.5	8.4	8.4	33.6	33.5	33.5	7.6	7.7	7.6	104.4	104.3	104.4	1.5	1.4	1.5	1.6	3.0	3.0	3.0	3.2
			Bottom	21.5	21.6	21.5	8.5	8.4	8.4	33.6	33.7	33.6	7.5	7.3	7.4	102.5	102.2	102.4	1.8	1.7	1.8		3.0	4.0	3.5	
CF	07:00	18.0	Surface	21.5	21.4	21.5	8.5	8.6	8.6	33.7	33.7	33.7	7.6	7.7	7.7	105.1	104.4	104.8	1.8	1.8	1.8		3.0	3.0	3.0	
			Middle	21.5	21.6	21.6	8.5	8.5	8.5	33.7	34.0	33.9	7.6	7.7	7.6	104.3	103.1	103.7	1.8	1.7	1.8	1.7	6.0	6.0	6.0	5.2
			Bottom	21.4	21.5	21.5	8.5	8.5	8.5	33.7	33.9	33.8	7.5	7.5	7.5	102.7	101.7	102.2	1.4	1.4	1.4		7.0	6.0	6.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 8-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	12:33	23.8	Surface	21.4	21.3	21.4	8.3	8.2	8.2	33.9	33.6	33.7	7.3	7.2	7.2	99.9	98.1	99.0	2.1	2.2	2.2		2.0	3.0	2.5	
			Middle	21.4	21.4	21.4	8.3	8.2	8.2	33.8	33.8	33.8	7.0	7.0	7.0	96.0	96.5	96.3	2.0	2.0	2.0	2.1	4.0	4.0	4.0	3.3
			Bottom	21.4	21.3	21.4	8.3	8.4	8.4	33.8	33.9	33.8	6.9	6.8	6.9	95.4	93.4	94.4	2.2	2.2	2.2		3.0	4.0	3.5	
I1	13:16	13.2	Surface	21.4	21.3	21.4	8.4	8.3	8.3	33.8	33.9	33.8	7.1	6.9	7.0	97.5	95.4	96.5	5.6	5.6	5.6		2.0	2.0	2.0	
			Middle	21.5	21.5	21.5	8.4	8.3	8.3	33.8	33.9	33.8	7.1	7.1	7.1	97.2	96.9	97.1	3.2	3.1	3.2	3.7	3.0	3.0	3.0	2.8
			Bottom	21.5	21.4	21.4	8.4	8.4	8.4	33.8	33.5	33.6	7.0	7.0	7.0	96.8	97.9	97.4	2.3	2.3	2.3		4.0	3.0	3.5	
I2	13:36	17.8	Surface	21.2	21.2	21.2	8.4	8.4	8.4	33.9	34.1	34.0	7.4	7.5	7.4	101.0	100.5	100.8	2.2	2.2	2.2		3.0	3.0	3.0	
			Middle	21.4	21.5	21.5	8.4	8.5	8.4	33.8	34.0	33.9	7.4	7.3	7.3	101.7	100.4	101.1	1.7	1.8	1.8	1.9	5.0	4.0	4.5	4.2
			Bottom	21.4	21.3	21.4	8.4	8.3	8.4	33.7	33.6	33.7	7.2	7.1	7.1	98.4	98.8	98.6	1.6	1.6	1.6		4.0	6.0	5.0	
Intake A	13:57	9.4	Surface	21.4	21.4	21.4	8.4	8.4	8.4	33.8	33.9	33.9	7.5	7.4	7.4	102.6	101.1	101.9	2.2	2.2	2.2		3.0	4.0	3.5	
			Middle	21.4	21.3	21.4	8.4	8.4	8.4	33.8	33.9	33.8	7.3	7.2	7.3	101.0	101.8	101.4	2.0	2.0	2.0	2.1	4.0	3.0	3.5	3.7
			Bottom	21.4	21.5	21.5	8.4	8.5	8.5	33.7	33.7	33.7	7.3	7.1	7.2	99.9	98.1	99.0	2.1	2.2	2.2		4.0	4.0	4.0	
Intake B	12:55	9.5	Surface	21.4	21.3	21.3	8.4	8.4	8.4	33.8	34.0	33.9	7.5	7.6	7.5	102.8	102.1	102.5	2.1	2.1	2.1		6.0	6.0	6.0	
			Middle	21.5	21.4	21.4	8.4	8.4	8.4	33.8	33.6	33.7	7.3	7.2	7.2	99.8	98.6	99.2	1.9	1.8	1.9	1.9	6.0	6.0	6.0	6.5
			Bottom	21.5	21.6	21.5	8.4	8.3	8.3	33.8	33.6	33.7	7.1	7.3	7.2	97.6	97.9	97.8	1.8	1.8	1.8		8.0	7.0	7.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 10-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	09:06	14.2	Surface	21.3	21.1	21.2	8.3	8.4	8.4	33.2	33.3	33.3	7.4	7.4	7.4	101.3	99.5	100.4	5.4	5.2	5.3		3.0	3.0	3.0	
			Middle	21.3	21.2	21.3	8.3	8.4	8.4	33.2	33.4	33.3	7.3	7.1	7.2	98.3	99.2	98.8	5.2	5.4	5.3	5.2	2.0	4.0	3.0	3.2
			Bottom	21.3	21.3	21.3	8.3	8.3	8.3	33.2	33.4	33.3	7.1	7.0	7.0	94.9	93.9	94.4	5.1	4.9	5.0		3.0	4.0	3.5	
I2	09:26	18.1	Surface	21.3	21.3	21.3	8.3	8.2	8.3	33.2	33.0	33.1	7.4	7.5	7.5	101.3	102.0	101.7	5.4	5.5	5.5		3.0	2.0	2.5	
			Middle	21.3	21.4	21.4	8.3	8.4	8.4	33.2	33.0	33.1	7.4	7.3	7.4	101.6	101.0	101.3	5.4	5.6	5.5	5.5	2.0	2.0	2.0	2.3
			Bottom	21.3	21.2	21.3	8.3	8.4	8.4	33.2	32.9	33.1	7.4	7.5	7.5	101.5	99.8	100.7	5.6	5.5	5.6		3.0	2.0	2.5	
Intake A	09:47	9.4	Surface	21.3	21.3	21.3	8.3	8.3	8.3	33.3	33.3	33.3	7.3	7.4	7.4	100.3	101.0	100.7	5.9	5.9	5.9		3.0	3.0	3.0	
			Middle	21.3	21.2	21.3	8.3	8.2	8.2	33.2	33.5	33.4	7.3	7.4	7.4	100.5	101.3	100.9	5.5	5.6	5.6	5.6	3.0	3.0	3.0	3.0
			Bottom	21.3	21.5	21.4	8.3	8.3	8.3	33.2	33.1	33.2	7.3	7.4	7.4	100.3	102.4	101.4	5.3	5.1	5.2		3.0	3.0	3.0	
Intake B	08:45	9.5	Surface	21.3	21.4	21.3	8.3	8.4	8.4	33.6	33.5	33.5	7.2	7.3	7.3	99.2	99.2	99.2	5.2	5.2	5.2		3.0	3.0	3.0	
			Middle	21.3	21.2	21.3	8.3	8.4	8.4	33.5	33.7	33.6	7.2	7.2	7.2	99.3	100.8	100.1	5.2	5.1	5.2	5.2	2.0	2.0	2.0	2.7
			Bottom	21.3	21.1	21.2	8.4	8.4	8.4	33.5	33.8	33.6	7.2	7.2	7.2	99.1	98.5	98.8	5.2	5.1	5.2		3.0	3.0	3.0	
CF	10:08	18.2	Surface	21.3	21.1	21.2	8.4	8.3	8.3	33.2	33.1	33.2	7.4	7.5	7.5	101.4	102.7	102.1	5.4	5.6	5.5		4.0	3.0	3.5	
			Middle	21.3	21.3	21.3	8.3	8.3	8.3	33.2	33.0	33.1	7.2	7.2	7.2	98.1	96.3	97.2	5.2	5.4	5.3	5.3	2.0	3.0	2.5	2.7
			Bottom	21.3	21.3	21.3	8.4	8.3	8.3	33.2	33.0	33.1	7.1	7.0	7.0	94.8	95.1	95.0	5.0	4.9	5.0		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 10-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	14:15	24.0	Surface	21.3	21.3	21.3	8.3	8.4	8.4	33.2	32.9	33.1	7.4	7.3	7.4	102.0	102.5	102.3	5.7	5.9	5.8		3.0	4.0	3.5	
			Middle	21.3	21.5	21.4	8.3	8.3	8.3	33.2	33.2	33.2	7.1	7.2	7.2	97.0	99.1	98.1	5.2	5.0	5.1	5.4	4.0	4.0	4.0	4.0
			Bottom	21.4	21.6	21.5	8.3	8.4	8.4	33.3	33.2	33.3	7.0	6.9	7.0	95.6	93.6	94.6	5.1	5.2	5.2		5.0	4.0	4.5	
I1	14:58	13.1	Surface	21.4	21.5	21.5	8.3	8.4	8.4	33.3	33.0	33.2	7.5	7.6	7.6	102.9	101.3	102.1	5.1	5.0	5.1		3.0	3.0	3.0	
			Middle	21.4	21.5	21.5	8.3	8.3	8.3	33.0	32.8	32.9	7.0	7.1	7.1	96.4	96.8	96.6	5.2	5.4	5.3	5.2	3.0	3.0	3.0	3.3
			Bottom	21.2	21.4	21.3	8.3	8.3	8.3	33.3	33.1	33.2	6.8	6.9	6.9	92.9	94.7	93.8	5.2	5.1	5.2		4.0	4.0	4.0	
I2	15:18	17.9	Surface	21.2	21.2	21.2	8.3	8.4	8.4	33.2	33.1	33.2	7.3	7.2	7.3	100.2	101.8	101.0	5.7	5.5	5.6		2.0	3.0	2.5	
			Middle	21.5	21.4	21.5	8.3	8.4	8.4	33.1	32.9	33.0	7.5	7.5	7.5	103.0	102.1	102.6	5.4	5.6	5.5	5.4	3.0	4.0	3.5	3.0
			Bottom	21.3	21.4	21.4	8.3	8.3	8.3	33.1	33.1	33.1	7.5	7.5	7.5	102.1	103.3	102.7	5.2	5.0	5.1		2.0	4.0	3.0	
Intake A	15:39	9.5	Surface	21.3	21.2	21.3	8.3	8.3	8.3	33.0	33.0	33.0	7.2	7.3	7.3	98.3	98.5	98.4	6.0	5.7	5.9		3.0	3.0	3.0	
			Middle	21.3	21.4	21.4	8.3	8.3	8.3	33.1	33.3	33.2	7.2	7.3	7.3	98.5	96.6	97.6	6.1	6.0	6.1	6.0	3.0	3.0	3.0	3.0
			Bottom	21.1	21.0	21.1	8.3	8.3	8.3	33.3	33.3	33.3	7.4	7.4	7.4	101.5	100.6	101.1	5.9	6.2	6.1		3.0	3.0	3.0	
Intake B	14:37	9.5	Surface	21.4	21.6	21.5	8.3	8.3	8.3	33.3	33.4	33.4	7.3	7.4	7.4	99.7	100.6	100.2	4.9	4.8	4.9		3.0	2.0	2.5	
			Middle	21.5	21.5	21.5	8.3	8.3	8.3	33.6	33.4	33.5	7.1	7.0	7.1	98.4	99.7	99.1	5.0	5.0	5.0	5.1	3.0	3.0	3.0	3.0
			Bottom	21.3	21.1	21.2	8.3	8.3	8.3	33.5	33.7	33.6	7.2	7.2	7.2	98.8	96.7	97.8	5.5	5.3	5.4		4.0	3.0	3.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 12-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	10:51	14.1	Surface	21.3	21.1	21.2	8.4	8.5	8.5	33.1	33.0	33.1	7.7	7.3	7.5	100.6	99.8	100.2	6.0	5.9	6.0		2.0	2.0	2.0	
			Middle	21.0	20.8	20.9	8.3	8.3	8.3	32.8	33.0	32.9	7.3	7.3	7.3	98.0	96.3	97.2	5.2	5.2	5.2	5.3	2.0	2.0	2.0	2.0
			Bottom	21.3	21.5	21.4	8.5	8.5	8.5	32.6	32.6	32.6	6.6	6.8	6.7	93.8	94.8	94.3	4.7	4.8	4.8		2.0	2.0	2.0	
I2	11:11	18.0	Surface	21.0	21.0	21.0	8.2	8.3	8.3	34.0	33.8	33.9	7.3	7.4	7.4	101.7	103.8	102.8	5.0	5.0	5.0		2.0	2.0	2.0	
			Middle	21.3	21.3	21.3	8.3	8.3	8.3	33.5	33.6	33.6	7.4	7.3	7.4	100.4	98.9	99.7	5.3	5.4	5.4	5.3	2.0	2.0	2.0	2.0
			Bottom	21.2	21.2	21.2	8.4	8.3	8.4	33.3	33.5	33.4	7.0	7.4	7.2	102.8	101.9	102.4	5.4	5.5	5.5		2.0	2.0	2.0	
Intake A	11:32	9.5	Surface	21.2	21.2	21.2	8.3	8.3	8.3	32.9	32.6	32.8	7.3	7.5	7.4	104.5	106.5	105.5	5.4	5.1	5.3		3.0	2.0	2.5	
			Middle	21.3	21.4	21.4	8.3	8.3	8.3	32.4	32.5	32.5	7.1	7.1	7.1	98.3	96.8	97.6	5.0	5.2	5.1	5.2	3.0	3.0	3.0	2.7
			Bottom	21.1	21.2	21.2	8.2	8.1	8.2	33.1	32.8	33.0	7.3	6.9	7.1	92.6	92.4	92.5	5.1	5.1	5.1		3.0	2.0	2.5	
Intake B	10:30	9.6	Surface	21.5	21.5	21.5	8.4	8.5	8.5	33.1	33.3	33.2	7.4	7.4	7.4	101.1	102.1	101.6	4.8	4.6	4.7		2.0	2.0	2.0	
			Middle	21.1	21.2	21.2	8.5	8.5	8.5	33.5	33.4	33.5	7.3	7.4	7.4	100.0	101.9	101.0	4.8	4.6	4.7	4.9	2.0	2.0	2.0	2.0
			Bottom	21.5	21.5	21.5	8.4	8.3	8.4	32.6	32.3	32.5	7.4	7.0	7.2	95.4	95.0	95.2	5.1	5.2	5.2		2.0	2.0	2.0	
CF	11:53	18.0	Surface	21.3	21.3	21.3	8.3	8.3	8.3	33.2	33.2	33.2	7.3	7.4	7.4	100.0	98.8	99.4	5.7	5.6	5.7		2.0	2.0	2.0	
			Middle	21.2	21.2	21.2	8.3	8.3	8.3	33.0	32.7	32.9	7.2	7.1	7.2	98.8	99.2	99.0	5.8	5.7	5.8	5.5	2.0	2.0	2.0	2.0
			Bottom	21.3	21.5	21.4	8.4	8.3	8.4	33.3	33.3	33.3	6.9	7.2	7.1	97.0	95.9	96.5	5.3	5.1	5.2		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 12-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	16:00	24.2	Surface	21.7	21.8	21.8	8.4	8.4	8.4	33.7	33.8	33.8	7.6	7.5	7.6	102.0	102.4	102.2	5.2	5.1	5.2		2.0	2.0	2.0	
			Middle	21.0	21.0	21.0	8.3	8.4	8.4	33.3	33.6	33.5	6.9	7.3	7.1	97.0	95.4	96.2	5.1	5.0	5.1	5.1	2.0	2.0	2.0	2.0
			Bottom	21.2	21.4	21.3	8.3	8.3	8.3	33.2	33.5	33.4	6.9	6.9	6.9	95.6	94.0	94.8	5.0	5.1	5.1		2.0	2.0	2.0	
I1	16:43	13.2	Surface	21.3	21.4	21.4	8.3	8.3	8.3	33.2	33.0	33.1	7.1	7.6	7.4	102.9	102.9	102.9	5.5	5.6	5.6		2.0	2.0	2.0	
			Middle	21.3	21.3	21.3	8.3	8.3	8.3	32.8	32.5	32.7	7.2	6.9	7.1	96.4	98.2	97.3	5.3	5.3	5.3	5.3	2.0	2.0	2.0	2.0
			Bottom	21.1	21.0	21.1	8.3	8.4	8.4	33.4	33.6	33.5	7.3	6.7	7.0	92.9	92.5	92.7	5.0	5.1	5.1		2.0	2.0	2.0	
I2	17:03	17.8	Surface	21.5	21.4	21.5	8.3	8.3	8.3	33.3	33.4	33.4	7.2	7.2	7.2	100.2	101.9	101.1	4.8	4.6	4.7		2.0	2.0	2.0	
			Middle	21.2	21.1	21.2	8.3	8.4	8.4	33.4	33.5	33.5	7.2	7.6	7.4	103.0	104.6	103.8	4.4	4.3	4.4	4.6	2.0	2.0	2.0	2.0
			Bottom	21.2	21.1	21.2	8.3	8.4	8.4	33.3	33.1	33.2	7.1	7.4	7.3	102.1	101.8	102.0	4.9	4.8	4.9		2.0	2.0	2.0	
Intake A	17:24	9.4	Surface	21.3	21.2	21.3	8.3	8.3	8.3	33.6	33.5	33.6	7.7	7.3	7.5	98.3	97.6	98.0	5.6	5.6	5.6		3.0	3.0	3.0	
			Middle	21.3	21.3	21.3	8.3	8.2	8.2	32.9	32.9	32.9	6.9	7.3	7.1	98.5	98.3	98.4	5.2	5.3	5.3	5.3	3.0	3.0	3.0	3.0
			Bottom	21.3	21.1	21.2	8.3	8.3	8.3	33.2	32.9	33.1	6.6	7.3	7.0	101.5	101.0	101.3	5.1	5.2	5.2		3.0	3.0	3.0	
Intake B	16:22	9.3	Surface	21.1	21.2	21.2	8.3	8.3	8.3	33.3	33.1	33.2	7.2	7.4	7.3	99.7	99.4	99.6	5.0	5.2	5.1		2.0	2.0	2.0	
			Middle	21.5	21.6	21.6	8.4	8.3	8.3	33.2	32.9	33.1	7.6	7.1	7.4	98.4	97.4	97.9	5.2	5.0	5.1	5.2	2.0	2.0	2.0	2.0
			Bottom	21.1	21.2	21.2	8.3	8.4	8.4	33.2	33.2	33.2	7.4	7.3	7.4	98.8	97.0	97.9	5.5	5.5	5.5		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 16-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	13:51	13.1	Surface	21.0	20.9	21.0	8.3	8.3	8.3	33.8	34.0	33.9	7.1	7.0	7.1	96.8	98.8	97.8	4.6	4.6	4.6		4.0	3.0	3.5	
			Middle	20.9	21.0	21.0	8.2	8.3	8.3	33.3	33.0	33.2	7.3	7.4	7.4	99.4	100.2	99.8	4.4	4.2	4.3	4.7	3.0	2.0	2.5	2.7
			Bottom	21.1	21.1	21.1	8.5	8.5	8.5	33.8	33.9	33.9	7.3	7.1	7.2	96.7	98.6	97.7	5.1	5.3	5.2		2.0	2.0	2.0	
I2	14:11	17.6	Surface	20.9	20.9	20.9	8.3	8.3	8.3	33.9	34.1	34.0	7.2	7.5	7.4	101.8	103.5	102.7	4.4	4.3	4.4		2.0	3.0	2.5	
			Middle	21.2	21.3	21.3	8.1	8.1	8.1	33.0	32.9	33.0	7.5	7.5	7.5	103.1	103.0	103.1	4.5	4.7	4.6	4.4	2.0	2.0	2.0	2.5
			Bottom	21.2	21.3	21.3	8.5	8.5	8.5	33.0	32.8	32.9	7.5	7.7	7.6	103.4	103.9	103.7	4.2	4.2	4.2		4.0	2.0	3.0	
Intake A	14:32	9.2	Surface	21.3	21.2	21.3	8.5	8.6	8.6	32.8	32.6	32.7	7.5	7.5	7.5	103.5	102.9	103.2	5.2	5.0	5.1		2.0	2.0	2.0	
			Middle	20.9	20.8	20.9	8.4	8.3	8.4	33.0	33.2	33.1	7.2	7.1	7.2	97.7	99.1	98.4	5.3	5.1	5.2	4.9	2.0	2.0	2.0	2.0
			Bottom	21.1	21.0	21.1	8.5	8.6	8.6	33.0	33.2	33.1	7.0	6.8	6.9	94.7	93.4	94.1	4.4	4.5	4.5		2.0	2.0	2.0	
Intake B	13:30	9.3	Surface	21.4	21.5	21.5	8.6	8.6	8.6	33.0	33.1	33.1	7.6	7.4	7.5	103.0	102.5	102.8	4.4	4.2	4.3		2.0	2.0	2.0	
			Middle	21.1	21.0	21.1	8.5	8.6	8.6	33.9	34.1	34.0	7.5	7.4	7.5	100.0	99.4	99.7	4.2	4.2	4.2	4.1	2.0	2.0	2.0	2.0
			Bottom	21.8	22.0	21.9	8.5	8.5	8.5	32.5	32.3	32.4	6.9	7.0	7.0	96.0	97.8	96.9	3.9	3.9	3.9		2.0	2.0	2.0	
CF	14:53	18.0	Surface	21.0	20.9	21.0	8.2	8.2	8.2	32.8	32.7	32.8	7.7	7.6	7.7	104.9	103.9	104.4	4.6	4.7	4.7		2.0	2.0	2.0	
			Middle	21.3	21.3	21.3	8.4	8.5	8.5	32.9	33.0	33.0	7.3	7.1	7.2	96.4	95.1	95.8	3.9	4.1	4.0	4.4	2.0	2.0	2.0	2.0
			Bottom	21.1	21.3	21.2	8.3	8.3	8.3	33.2	33.0	33.1	6.7	6.8	6.8	91.4	93.3	92.4	4.5	4.6	4.6		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 16-Dec-14  
 Tide: Mid-Ebb  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)				Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**	
CE	07:02	24.0	Surface	21.5	21.6	21.6	8.5	8.4	8.5	33.6	33.5	33.6	7.1	7.1	7.1	98.7	98.6	98.7	5.1	5.3	5.2		3.0	3.0	3.0		
			Middle	21.1	21.1	21.1	8.3	8.3	8.3	32.8	32.7	32.8	7.2	7.2	7.2	99.0	100.1	99.6	5.2	5.2	5.2	5.0	2.0	3.0	2.5	2.7	
			Bottom	21.3	21.1	21.2	8.6	8.6	8.6	32.3	32.4	32.4	6.8	6.9	6.9	91.5	90.4	91.0	4.7	4.5	4.6		2.0	3.0	2.5		
I1	07:45	12.9	Surface	21.4	21.5	21.5	8.3	8.3	8.3	33.7	33.7	33.7	7.2	7.3	7.3	98.9	98.8	98.9	4.9	4.9	4.9		2.0	2.0	2.0		
			Middle	21.0	20.9	21.0	8.5	8.4	8.5	33.7	34.0	33.9	7.3	7.0	7.2	96.6	95.3	96.0	4.7	4.6	4.7	4.9	2.0	3.0	2.5	2.2	
			Bottom	21.2	21.4	21.3	8.4	8.3	8.4	32.5	32.3	32.4	6.9	7.1	7.0	95.6	95.4	95.5	5.0	5.2	5.1		2.0	2.0	2.0		
I2	08:05	17.5	Surface	21.6	21.6	21.6	8.3	8.4	8.4	33.5	33.5	33.5	7.4	7.4	7.4	101.3	100.1	100.7	4.5	4.6	4.6		2.0	2.0	2.0		
			Middle	21.0	21.1	21.1	8.1	8.0	8.1	33.3	33.3	33.3	7.1	7.5	7.3	99.8	99.7	99.8	4.4	4.6	4.5	4.6	2.0	2.0	2.0	2.0	
			Bottom	21.2	21.1	21.2	8.3	8.3	8.3	33.9	33.7	33.8	7.2	7.3	7.3	99.4	98.3	98.9	4.7	4.8	4.8		2.0	2.0	2.0		
Intake A	08:26	9.5	Surface	20.9	21.0	21.0	8.2	8.3	8.3	33.6	33.3	33.5	7.4	7.3	7.4	100.8	99.8	100.3	4.7	4.6	4.7		3.0	2.0	2.5		
			Middle	21.6	21.8	21.7	8.2	8.1	8.2	33.7	33.6	33.7	7.4	7.4	7.4	101.7	100.6	101.2	5.2	5.3	5.3	4.9	2.0	2.0	2.0	2.2	
			Bottom	21.0	21.2	21.1	8.4	8.4	8.4	33.5	33.6	33.6	7.6	7.8	7.7	106.2	106.3	106.3	4.8	5.0	4.9		2.0	2.0	2.0		
Intake B	07:24	9.6	Surface	21.2	21.3	21.3	8.2	8.3	8.3	33.1	32.8	33.0	7.6	7.4	7.5	102.5	101.9	102.2	4.8	4.6	4.7		2.0	2.0	2.0		
			Middle	21.5	21.6	21.6	8.4	8.5	8.5	32.3	32.2	32.3	7.2	7.3	7.3	100.1	102.1	101.1	5.1	4.9	5.0	5.0	2.0	2.0	2.0	2.2	
			Bottom	21.0	20.9	21.0	8.2	8.3	8.3	32.8	32.8	32.8	6.8	7.0	6.9	94.5	94.3	94.4	5.2	5.4	5.3		2.0	3.0	2.5		

Remark or Observation: Mid-ebb tide of 16 Dec (06:59) is marginally beyond the normal working hour, however it is considered to be acceptable for conducting monitoring

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 18-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	15:05	13.0	Surface	19.5	19.7	19.6	8.4	8.4	8.4	32.9	32.9	32.9	7.3	7.4	7.4	97.2	96.7	97.0	1.0	1.0	1.0		2.0	3.0	2.5	
			Middle	19.5	19.4	19.5	8.4	8.3	8.4	32.9	32.9	32.9	7.3	7.2	7.3	97.0	96.9	97.0	0.8	0.8	0.8	0.9	3.0	2.0	2.5	2.8
			Bottom	19.5	19.6	19.6	8.4	8.5	8.5	32.9	33.1	33.0	7.3	7.4	7.4	96.7	96.1	96.4	0.8	0.8	0.8		3.0	4.0	3.5	
I2	15:25	17.9	Surface	19.5	19.5	19.5	8.4	8.4	8.4	32.9	32.7	32.8	7.3	7.2	7.3	97.0	98.5	97.8	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.5	19.6	19.6	8.4	8.5	8.5	32.9	32.7	32.8	7.3	7.2	7.3	97.0	98.0	97.5	0.8	0.8	0.8	0.9	2.0	2.0	2.0	2.0
			Bottom	19.5	19.7	19.6	8.4	8.4	8.4	32.9	32.9	32.9	7.3	7.3	7.3	96.7	96.6	96.7	1.1	1.1	1.1		2.0	2.0	2.0	
Intake A	15:46	9.1	Surface	19.5	19.4	19.5	8.4	8.3	8.4	32.9	32.7	32.8	7.3	7.4	7.4	97.0	97.4	97.2	1.0	1.0	1.0		2.0	2.0	2.0	
			Middle	19.5	19.7	19.6	8.4	8.4	8.4	32.9	33.1	33.0	7.3	7.3	7.3	97.2	98.9	98.1	0.9	0.9	0.9	0.9	2.0	3.0	2.5	2.2
			Bottom	19.5	19.6	19.6	8.4	8.4	8.4	32.9	32.7	32.8	7.3	7.4	7.4	96.9	94.9	95.9	0.7	0.7	0.7		2.0	2.0	2.0	
Intake B	14:45	9.4	Surface	19.5	19.4	19.5	8.4	8.5	8.5	32.9	33.1	33.0	7.4	7.2	7.3	97.3	98.1	97.7	1.2	1.2	1.2		2.0	2.0	2.0	
			Middle	19.5	19.5	19.5	8.4	8.4	8.4	32.9	33.2	33.1	7.4	7.5	7.4	97.3	97.1	97.2	0.8	0.8	0.8	1.0	2.0	2.0	2.0	2.0
			Bottom	19.5	19.4	19.5	8.4	8.4	8.4	32.9	32.7	32.8	7.3	7.2	7.3	96.9	95.9	96.4	0.9	0.9	0.9		2.0	2.0	2.0	
CF	16:07	18.2	Surface	19.5	19.5	19.5	8.4	8.3	8.4	32.9	32.9	32.9	7.3	7.5	7.4	97.1	95.4	96.3	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.5	19.6	19.6	8.4	8.4	8.4	32.9	33.2	33.1	7.3	7.5	7.4	97.1	98.5	97.8	1.1	1.1	1.1	0.9	2.0	2.0	2.0	2.0
			Bottom	19.5	19.6	19.6	8.4	8.4	8.4	32.9	32.8	32.9	7.3	7.5	7.4	97.0	98.9	98.0	0.8	0.8	0.8		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 18-Dec-14  
 Tide: Mid-Ebb  
 Weather: Sunny  
 Sea Conditions: calm  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	09:00	24.2	Surface	19.5	19.5	19.5	8.4	8.3	8.4	33.1	33.0	33.0	7.4	7.4	7.4	97.5	96.1	96.8	0.5	0.5	0.5		3.0	3.0	3.0	
			Middle	19.6	19.7	19.6	8.4	8.3	8.4	33.1	33.3	33.2	7.3	7.4	7.4	97.2	97.5	97.4	0.8	0.8	0.8	0.7	4.0	4.0	4.0	3.7
			Bottom	19.6	19.6	19.6	8.4	8.3	8.4	33.1	33.0	33.1	7.3	7.2	7.3	96.8	98.1	97.5	0.7	0.7	0.7		4.0	4.0	4.0	
I1	09:43	13.1	Surface	19.5	19.4	19.5	8.4	8.4	8.4	33.1	33.2	33.1	7.3	7.4	7.4	97.1	97.7	97.4	0.9	0.9	0.9		2.0	2.0	2.0	
			Middle	19.5	19.5	19.5	8.4	8.4	8.4	33.1	33.3	33.2	7.3	7.4	7.4	97.2	98.7	98.0	1.1	1.1	1.1	1.0	2.0	3.0	2.5	2.3
			Bottom	19.5	19.7	19.6	8.4	8.5	8.5	33.1	33.0	33.0	7.3	7.3	7.3	96.8	94.9	95.9	0.9	0.9	0.9		2.0	3.0	2.5	
I2	10:03	17.4	Surface	19.5	19.6	19.6	8.4	8.5	8.5	33.0	33.2	33.1	7.3	7.5	7.4	97.2	98.5	97.9	0.7	0.7	0.7		2.0	2.0	2.0	
			Middle	19.5	19.5	19.5	8.4	8.4	8.4	33.0	33.2	33.1	7.3	7.3	7.3	97.2	96.4	96.8	0.7	0.7	0.7	0.7	2.0	2.0	2.0	2.2
			Bottom	19.5	19.4	19.5	8.4	8.4	8.4	33.0	33.0	33.0	7.3	7.3	7.3	96.8	97.5	97.2	0.8	0.8	0.8		2.0	3.0	2.5	
Intake A	10:24	9.3	Surface	19.5	19.4	19.5	8.4	8.4	8.4	33.0	32.7	32.8	7.3	7.4	7.4	97.2	98.4	97.8	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.5	19.6	19.6	8.4	8.3	8.4	32.9	32.8	32.9	7.3	7.5	7.4	97.1	95.0	96.1	0.8	0.8	0.8	0.8	2.0	2.0	2.0	2.0
			Bottom	19.5	19.6	19.6	8.4	8.3	8.4	32.9	33.1	33.0	7.3	7.3	7.3	97.0	97.0	97.0	0.8	0.8	0.8		2.0	2.0	2.0	
Intake B	09:22	9.5	Surface	19.6	19.4	19.5	8.4	8.5	8.5	33.1	32.9	33.0	7.3	7.5	7.4	97.0	98.6	97.8	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.5	19.5	19.5	8.4	8.3	8.4	33.1	33.3	33.2	7.3	7.5	7.4	96.9	98.2	97.6	0.7	0.7	0.7	0.7	3.0	3.0	3.0	2.8
			Bottom	19.5	19.7	19.6	8.4	8.3	8.4	33.1	33.2	33.1	7.3	7.2	7.2	96.7	97.2	97.0	0.7	0.7	0.7		3.0	4.0	3.5	

Remark or Obsevation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 20-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	16:21	13.2	Surface	19.1	18.9	19.0	8.3	8.3	8.3	32.8	32.6	32.7	8.0	8.1	8.0	104.8	102.5	103.7	1.1	1.1	1.1		2.0	2.0	2.0	
			Middle	19.1	18.9	19.0	8.4	8.3	8.3	32.7	32.6	32.7	7.7	7.8	7.7	100.8	100.1	100.5	0.8	0.8	0.8	0.9	2.0	2.0	2.0	2.0
			Bottom	19.1	19.2	19.1	8.4	8.3	8.3	32.7	32.5	32.6	7.5	7.6	7.6	98.6	99.3	99.0	0.7	0.7	0.7		2.0	2.0	2.0	
I2	16:41	18.1	Surface	19.1	18.9	19.0	8.4	8.4	8.4	32.7	33.0	32.9	7.4	7.4	7.4	97.1	95.8	96.5	0.9	0.9	0.9		2.0	2.0	2.0	
			Middle	19.1	19.1	19.1	8.4	8.3	8.3	32.7	32.6	32.7	7.4	7.4	7.4	96.8	96.0	96.4	0.7	0.7	0.7	0.8	2.0	2.0	2.0	2.0
			Bottom	19.1	19.1	19.1	8.4	8.4	8.4	32.7	33.0	32.9	7.4	7.4	7.4	96.4	95.8	96.1	0.7	0.7	0.7		2.0	2.0	2.0	
Intake A	17:02	9.2	Surface	19.1	18.9	19.0	8.4	8.4	8.4	32.7	32.7	32.7	7.4	7.5	7.4	96.6	96.4	96.5	0.7	0.7	0.7		2.0	2.0	2.0	
			Middle	19.1	19.0	19.0	8.4	8.5	8.4	32.7	32.5	32.6	7.4	7.3	7.3	96.7	97.8	97.3	0.7	0.7	0.7	0.7	2.0	2.0	2.0	2.0
			Bottom	19.1	18.9	19.0	8.4	8.3	8.3	32.7	32.6	32.7	7.4	7.3	7.3	96.5	97.8	97.2	0.8	0.8	0.8		2.0	2.0	2.0	
Intake B	16:00	9.5	Surface	19.0	19.1	19.1	8.4	8.4	8.4	32.6	32.7	32.6	7.3	7.5	7.4	95.9	97.1	96.5	0.9	0.9	0.9		2.0	2.0	2.0	
			Middle	19.0	18.9	19.0	8.4	8.3	8.3	32.6	32.6	32.6	7.3	7.3	7.3	95.4	93.3	94.4	0.7	0.7	0.7	0.8	2.0	2.0	2.0	2.0
			Bottom	19.1	19.2	19.1	8.4	8.5	8.5	32.7	32.9	32.8	7.3	7.2	7.3	95.6	97.4	96.5	0.7	0.7	0.7		2.0	2.0	2.0	
CF	17:23	18.4	Surface	19.1	19.2	19.1	8.4	8.5	8.4	32.6	32.8	32.7	7.4	7.3	7.3	96.3	97.0	96.7	0.7	0.7	0.7		2.0	2.0	2.0	
			Middle	19.0	19.0	19.0	8.4	8.4	8.4	32.6	32.9	32.8	7.3	7.3	7.3	96.0	97.3	96.7	0.6	0.6	0.6	0.7	2.0	2.0	2.0	2.0
			Bottom	19.1	19.0	19.0	8.4	8.4	8.4	32.7	32.6	32.6	7.3	7.4	7.4	96.0	96.1	96.1	0.7	0.7	0.7		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 20-Dec-14  
 Tide: Mid-Ebb  
 Weather: Sunny  
 Sea Conditions: calm  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	10:30	24.6	Surface	19.0	19.0	19.0	8.2	8.3	8.2	32.9	33.1	33.0	8.1	8.3	8.2	106.6	107.6	107.1	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.1	19.1	19.1	8.3	8.3	8.3	32.9	33.1	33.0	7.6	7.5	7.5	99.5	100.3	99.9	1.5	1.6	1.6	1.1	2.0	2.0	2.0	2.3
			Bottom	19.1	18.9	19.0	8.3	8.4	8.4	32.9	32.8	32.9	7.4	7.4	7.4	97.5	97.8	97.7	1.0	1.0	1.0		3.0	3.0	3.0	
I1	11:13	13.0	Surface	19.0	19.0	19.0	8.4	8.3	8.3	32.8	32.5	32.6	7.4	7.4	7.4	96.5	96.1	96.3	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.0	18.8	18.9	8.4	8.4	8.4	32.8	32.8	32.8	7.4	7.3	7.3	96.3	96.9	96.6	0.8	0.8	0.8	0.8	2.0	2.0	2.0	2.0
			Bottom	19.1	18.9	19.0	8.4	8.4	8.4	32.8	32.8	32.8	7.4	7.3	7.3	96.5	97.5	97.0	0.7	0.7	0.7		2.0	2.0	2.0	
I2	11:33	17.2	Surface	19.1	19.2	19.1	8.4	8.5	8.4	32.7	32.9	32.8	7.4	7.2	7.3	96.6	97.6	97.1	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.1	18.9	19.0	8.4	8.3	8.3	32.7	32.8	32.8	7.4	7.5	7.4	96.6	96.3	96.5	0.7	0.7	0.7	0.7	2.0	2.0	2.0	2.2
			Bottom	19.1	19.0	19.0	8.4	8.3	8.3	32.7	32.7	32.7	7.4	7.2	7.3	96.6	96.6	96.6	0.7	0.7	0.7		2.0	3.0	2.5	
Intake A	11:54	9.1	Surface	19.1	19.1	19.1	8.4	8.3	8.3	32.7	32.4	32.5	7.4	7.3	7.3	96.5	96.2	96.4	0.8	0.8	0.8		2.0	2.0	2.0	
			Middle	19.0	19.2	19.1	8.4	8.4	8.4	32.7	32.5	32.6	7.4	7.4	7.4	96.4	96.9	96.7	0.7	0.7	0.7	0.7	2.0	2.0	2.0	2.0
			Bottom	19.1	19.2	19.1	8.4	8.4	8.4	32.7	33.0	32.9	7.3	7.4	7.4	96.2	97.4	96.8	0.7	0.7	0.7		2.0	2.0	2.0	
Intake B	10:52	9.5	Surface	19.0	19.0	19.0	8.3	8.4	8.4	32.9	33.0	32.9	7.4	7.2	7.3	96.9	95.6	96.3	0.7	0.7	0.7		2.0	2.0	2.0	
			Middle	19.1	19.1	19.1	8.4	8.4	8.4	32.9	33.2	33.1	7.4	7.3	7.3	96.5	96.5	96.5	0.8	0.8	0.8	0.8	2.0	2.0	2.0	2.0
			Bottom	19.1	18.9	19.0	8.4	8.3	8.3	32.9	32.9	32.9	7.4	7.3	7.3	96.6	95.8	96.2	0.8	0.8	0.8		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 22-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	17:51	13.0	Surface	18.5	18.5	18.5	8.5	8.6	8.6	32.8	32.9	32.9	7.7	7.7	7.7	99.6	101.0	100.3	4.0	4.0	4.0		3.0	2.0	2.5	
			Middle	18.6	18.5	18.5	8.5	8.5	8.5	32.8	32.8	32.8	7.7	7.7	7.7	99.7	99.2	99.5	2.2	2.2	2.2	2.7	3.0	2.0	2.5	2.8
			Bottom	18.6	18.5	18.5	8.5	8.4	8.5	32.8	33.1	33.0	7.7	7.6	7.6	99.7	100.7	100.2	2.0	2.0	2.0		3.0	4.0	3.5	
I2	18:11	18.0	Surface	18.6	18.7	18.6	8.5	8.5	8.5	32.9	33.0	32.9	7.7	7.7	7.7	99.6	98.0	98.8	1.8	1.9	1.9		2.0	2.0	2.0	
			Middle	18.6	18.4	18.5	8.5	8.5	8.5	32.9	32.8	32.8	7.7	7.6	7.6	99.6	101.4	100.5	1.5	1.5	1.5	1.6	2.0	2.0	2.0	2.5
			Bottom	18.6	18.5	18.5	8.5	8.4	8.5	32.9	33.1	33.0	7.7	7.8	7.7	99.7	101.0	100.4	1.5	1.5	1.5		3.0	4.0	3.5	
Intake A	18:32	9.5	Surface	18.5	18.4	18.5	8.5	8.5	8.5	32.9	32.7	32.8	7.7	7.6	7.6	99.6	99.3	99.5	3.2	3.3	3.3		3.0	3.0	3.0	
			Middle	18.6	18.5	18.5	8.5	8.6	8.6	32.9	32.9	32.9	7.7	7.5	7.6	99.7	98.7	99.2	2.9	3.0	3.0	2.8	4.0	3.0	3.5	3.5
			Bottom	18.6	18.5	18.5	8.5	8.5	8.5	32.9	33.0	32.9	7.7	7.7	7.7	99.6	98.2	98.9	2.2	2.3	2.3		4.0	4.0	4.0	
Intake B	17:30	9.5	Surface	18.6	18.5	18.5	8.5	8.4	8.5	32.9	33.0	32.9	7.7	7.5	7.6	99.8	100.7	100.3	4.3	4.1	4.2		2.0	3.0	2.5	
			Middle	18.6	18.6	18.6	8.5	8.4	8.5	32.9	32.6	32.7	7.7	7.7	7.7	99.7	97.7	98.7	1.9	1.8	1.9	2.6	3.0	3.0	3.0	3.0
			Bottom	18.6	18.7	18.6	8.5	8.5	8.5	32.9	32.7	32.8	7.7	7.7	7.7	99.6	98.8	99.2	1.6	1.7	1.7		4.0	3.0	3.5	
CF	18:53	18.3	Surface	18.5	18.7	18.6	8.5	8.5	8.5	32.9	32.6	32.7	7.7	7.6	7.6	99.5	99.9	99.7	0.6	0.6	0.6		2.0	3.0	2.5	
			Middle	18.6	18.7	18.6	8.5	8.4	8.5	32.9	32.6	32.7	7.7	7.5	7.6	99.5	97.4	98.5	1.4	1.4	1.4	1.2	3.0	3.0	3.0	2.8
			Bottom	18.6	18.5	18.5	8.5	8.4	8.5	32.8	32.6	32.7	7.7	7.8	7.7	99.5	101.0	100.3	1.5	1.6	1.6		3.0	3.0	3.0	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 22-Dec-14  
 Tide: Mid-Ebb  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	12:15	24.4	Surface	18.5	18.7	18.6	8.5	8.5	8.5	32.8	32.8	32.8	7.7	7.6	7.6	99.8	97.9	98.9	2.6	2.7	2.7		3.0	4.0	3.5	
			Middle	18.6	18.7	18.6	8.5	8.5	8.5	32.8	32.9	32.9	7.7	7.6	7.6	99.9	98.0	99.0	1.7	1.7	1.7	2.0	4.0	3.0	3.5	3.7
			Bottom	18.6	18.4	18.5	8.5	8.6	8.5	32.8	32.5	32.7	7.7	7.6	7.6	99.6	100.4	100.0	1.5	1.6	1.6		4.0	4.0	4.0	
I1	12:58	13.2	Surface	18.5	18.4	18.5	8.5	8.4	8.5	32.8	32.8	32.8	7.7	7.6	7.6	99.6	99.6	99.6	4.1	4.0	4.1		3.0	3.0	3.0	
			Middle	18.6	18.7	18.6	8.5	8.5	8.5	32.8	33.0	32.9	7.7	7.8	7.7	99.7	98.9	99.3	3.7	3.7	3.7	3.5	3.0	3.0	3.0	3.0
			Bottom	18.6	18.5	18.5	8.5	8.5	8.5	32.8	32.8	32.8	7.7	7.6	7.6	99.5	98.3	98.9	2.6	2.6	2.6		3.0	3.0	3.0	
I2	13:18	17.1	Surface	18.6	18.4	18.5	8.5	8.6	8.6	32.8	32.6	32.7	7.7	7.6	7.6	99.5	97.6	98.6	1.3	1.2	1.3		3.0	3.0	3.0	
			Middle	18.6	18.5	18.5	8.5	8.4	8.4	32.8	33.0	32.9	7.7	7.6	7.6	99.6	101.1	100.4	1.5	1.6	1.6	1.4	3.0	4.0	3.5	3.3
			Bottom	18.6	18.6	18.6	8.5	8.5	8.5	32.8	32.7	32.8	7.7	7.6	7.6	99.5	99.7	99.6	1.4	1.4	1.4		4.0	3.0	3.5	
Intake A	13:39	9.5	Surface	18.6	18.7	18.6	8.5	8.4	8.4	32.8	33.1	33.0	7.7	7.5	7.6	99.4	100.3	99.9	1.3	1.2	1.3		3.0	4.0	3.5	
			Middle	18.6	18.5	18.5	8.5	8.4	8.4	32.8	32.8	32.8	7.6	7.7	7.7	99.3	99.7	99.5	1.2	1.2	1.2	1.3	3.0	3.0	3.0	3.3
			Bottom	18.6	18.4	18.5	8.5	8.5	8.5	32.8	32.5	32.7	7.7	7.6	7.6	99.5	100.5	100.0	1.3	1.3	1.3		3.0	4.0	3.5	
Intake B	12:37	9.3	Surface	18.6	18.4	18.5	8.5	8.4	8.4	32.8	32.9	32.9	7.7	7.7	7.7	99.4	98.6	99.0	1.6	1.6	1.6		2.0	2.0	2.0	
			Middle	18.6	18.7	18.6	8.5	8.4	8.4	32.8	32.5	32.7	7.7	7.5	7.6	99.6	98.0	98.8	1.4	1.5	1.5	1.5	4.0	4.0	4.0	3.5
			Bottom	18.6	18.7	18.6	8.5	8.6	8.5	32.8	32.7	32.8	7.7	7.7	7.7	99.6	97.8	98.7	1.4	1.4	1.4		5.0	4.0	4.5	

Remark or Observation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 24-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	08:36	13.1	Surface	18.3	18.1	18.2	8.4	8.5	8.5	32.7	32.5	32.6	7.6	7.7	7.7	98.4	97.1	97.8	2.0	2.0	2.0		2.0	3.0	2.5	
			Middle	18.3	18.1	18.2	8.4	8.4	8.4	32.7	32.5	32.6	7.6	7.7	7.7	98.5	98.7	98.6	1.7	1.7	1.7	1.8	3.0	2.0	2.5	2.5
			Bottom	18.3	18.1	18.2	8.4	8.4	8.4	32.7	32.6	32.6	7.6	7.7	7.7	98.1	97.6	97.9	1.7	1.7	1.7		3.0	2.0	2.5	
I2	08:56	17.9	Surface	18.3	18.4	18.3	8.4	8.5	8.5	32.7	32.4	32.5	7.6	7.6	7.6	98.4	99.0	98.7	1.5	1.5	1.5		2.0	3.0	2.5	
			Middle	18.3	18.2	18.2	8.4	8.4	8.4	32.7	32.4	32.5	7.6	7.6	7.6	98.4	96.5	97.5	2.3	2.2	2.3	1.9	2.0	2.0	2.0	2.7
			Bottom	18.3	18.4	18.3	8.4	8.4	8.4	32.7	32.8	32.7	7.6	7.8	7.7	98.2	98.0	98.1	2.0	2.1	2.1		3.0	4.0	3.5	
Intake A	09:17	9.3	Surface	18.3	18.2	18.2	8.4	8.5	8.5	32.7	32.6	32.6	7.6	7.5	7.6	98.4	96.7	97.6	1.8	1.7	1.8		3.0	2.0	2.5	
			Middle	18.3	18.1	18.2	8.4	8.4	8.4	32.7	32.5	32.6	7.6	7.7	7.7	98.6	97.2	97.9	2.0	2.0	2.0	1.9	4.0	3.0	3.5	3.2
			Bottom	18.3	18.4	18.3	8.4	8.4	8.4	32.7	33.0	32.8	7.6	7.5	7.6	98.2	97.4	97.8	1.9	1.8	1.9		3.0	4.0	3.5	
Intake B	08:15	9.2	Surface	18.3	18.2	18.2	8.4	8.4	8.4	32.6	32.8	32.7	7.6	7.7	7.7	98.3	100.1	99.2	1.7	1.7	1.7		2.0	2.0	2.0	
			Middle	18.3	18.2	18.2	8.4	8.4	8.4	32.6	32.7	32.7	7.6	7.5	7.6	98.4	99.9	99.2	1.8	1.9	1.9	2.0	2.0	3.0	2.5	2.3
			Bottom	18.3	18.1	18.2	8.4	8.4	8.4	32.7	32.9	32.8	7.6	7.5	7.5	97.9	97.2	97.6	2.6	2.5	2.6		2.0	3.0	2.5	
CF	09:38	18.0	Surface	18.3	18.1	18.2	8.4	8.5	8.5	32.6	32.8	32.7	7.6	7.5	7.6	98.4	99.4	98.9	1.8	1.8	1.8		2.0	2.0	2.0	
			Middle	18.3	18.4	18.3	8.4	8.4	8.4	32.6	32.8	32.7	7.6	7.7	7.7	98.4	98.3	98.4	1.8	1.9	1.9	1.8	2.0	3.0	2.5	2.3
			Bottom	18.3	18.3	18.3	8.4	8.5	8.5	32.6	32.9	32.8	7.6	7.8	7.7	98.1	98.7	98.4	1.6	1.6	1.6		2.0	3.0	2.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 24-Dec-14  
 Tide: Mid-Ebb  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	14:00	24.2	Surface	18.3	18.2	18.2	8.4	8.4	8.4	32.9	32.7	32.8	7.7	7.7	7.7	99.1	98.0	98.6	1.4	1.4	1.4		2.0	2.0	2.0	
			Middle	18.3	18.2	18.2	8.4	8.3	8.3	32.9	33.0	32.9	7.7	7.6	7.6	99.1	99.5	99.3	1.4	1.4	1.4	1.4	3.0	3.0	3.0	2.7
			Bottom	18.3	18.4	18.3	8.4	8.3	8.3	32.9	32.9	32.9	7.6	7.7	7.7	98.8	98.9	98.9	1.4	1.3	1.4		3.0	3.0	3.0	
I1	14:43	13.0	Surface	18.3	18.4	18.3	8.4	8.5	8.5	32.9	32.6	32.7	7.6	7.6	7.6	98.7	97.2	98.0	1.5	1.6	1.6		3.0	3.0	3.0	
			Middle	18.3	18.1	18.2	8.4	8.5	8.5	32.8	33.0	32.9	7.6	7.8	7.7	98.7	99.2	99.0	1.5	1.5	1.5	1.5	3.0	3.0	3.0	3.2
			Bottom	18.3	18.1	18.2	8.4	8.4	8.4	32.7	32.5	32.6	7.6	7.6	7.6	98.3	96.7	97.5	1.3	1.3	1.3		4.0	3.0	3.5	
I2	15:03	17.0	Surface	18.2	18.1	18.2	8.4	8.5	8.5	32.6	32.8	32.7	7.9	7.9	7.9	101.4	100.5	101.0	2.3	2.3	2.3		2.0	2.0	2.0	
			Middle	18.2	18.2	18.2	8.4	8.5	8.5	32.6	32.6	32.6	7.8	7.9	7.8	100.4	100.1	100.3	1.9	2.0	2.0	2.2	2.0	3.0	2.5	2.7
			Bottom	18.3	18.1	18.2	8.4	8.3	8.4	32.6	32.8	32.7	7.7	7.7	7.7	98.7	100.7	99.7	2.3	2.3	2.3		4.0	3.0	3.5	
Intake A	15:24	9.2	Surface	18.3	18.3	18.3	8.4	8.5	8.5	32.6	32.6	32.6	7.7	7.6	7.6	98.8	98.4	98.6	1.8	1.8	1.8		2.0	3.0	2.5	
			Middle	18.3	18.1	18.2	8.4	8.4	8.4	32.6	32.8	32.7	7.6	7.7	7.7	98.6	99.5	99.1	1.9	1.8	1.9	1.9	3.0	3.0	3.0	2.8
			Bottom	18.3	18.4	18.3	8.4	8.5	8.5	32.6	32.4	32.5	7.6	7.6	7.6	98.0	100.0	99.0	2.1	2.1	2.1		3.0	3.0	3.0	
Intake B	14:22	9.5	Surface	18.3	18.1	18.2	8.4	8.4	8.4	32.9	32.7	32.8	7.7	7.7	7.7	98.9	100.1	99.5	1.7	1.6	1.7		3.0	3.0	3.0	
			Middle	18.3	18.3	18.3	8.4	8.3	8.4	32.9	32.9	32.9	7.7	7.8	7.7	98.8	98.3	98.6	1.4	1.4	1.4	1.5	3.0	3.0	3.0	2.8
			Bottom	18.3	18.1	18.2	8.4	8.5	8.5	32.9	32.9	32.9	7.6	7.7	7.7	98.7	97.7	98.2	1.4	1.4	1.4		3.0	2.0	2.5	

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 27-Dec-14  
 Tide: Mid-Flood  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	10:21	13.8	Surface	18.5	18.6	18.5	8.3	8.4	8.4	32.7	32.7	32.7	7.1	7.3	7.2	96.2	94.5	95.4	1.8	1.9	1.9		2.0	2.0	2.0	
			Middle	18.5	18.4	18.4	8.4	8.4	8.4	32.7	32.9	32.8	7.2	7.4	7.3	96.7	94.7	95.7	1.9	1.9	1.9	1.9	2.0	2.0	2.0	2.0
			Bottom	18.4	18.5	18.5	8.4	8.3	8.3	32.7	32.8	32.8	7.1	7.3	7.2	96.3	95.9	96.1	1.9	2.0	2.0		2.0	2.0	2.0	
I2	10:41	18.2	Surface	18.4	18.4	18.4	8.4	8.4	8.4	32.8	33.0	32.9	7.3	7.7	7.5	98.0	96.8	97.4	1.7	1.6	1.7		2.0	2.0	2.0	
			Middle	18.4	18.5	18.5	8.4	8.3	8.3	32.7	32.6	32.7	7.2	7.4	7.3	96.8	95.2	96.0	1.8	1.8	1.8	1.9	2.0	2.0	2.0	2.0
			Bottom	18.4	18.5	18.5	8.3	8.3	8.3	32.7	33.0	32.9	7.0	7.2	7.1	94.1	94.9	94.5	2.3	2.3	2.3		2.0	2.0	2.0	
Intake A	11:02	9.3	Surface	18.5	18.3	18.4	8.3	8.3	8.3	32.7	32.9	32.8	7.1	7.3	7.2	95.5	96.5	96.0	2.3	2.3	2.3		2.0	2.0	2.0	
			Middle	18.4	18.5	18.5	8.3	8.4	8.4	32.7	32.7	32.7	7.0	7.3	7.1	93.8	92.4	93.1	2.1	2.1	2.1	2.1	2.0	2.0	2.0	2.0
			Bottom	18.4	18.3	18.3	8.3	8.4	8.4	32.7	32.5	32.6	6.9	7.0	6.9	92.7	93.2	93.0	1.9	2.0	2.0		2.0	2.0	2.0	
Intake B	10:00	9.1	Surface	18.5	18.7	18.6	8.3	8.3	8.3	32.7	32.5	32.6	7.3	7.8	7.5	98.6	99.8	99.2	1.7	1.6	1.7		2.0	2.0	2.0	
			Middle	18.4	18.6	18.5	8.4	8.4	8.4	32.7	32.7	32.7	7.2	7.4	7.3	97.8	96.6	97.2	1.7	1.6	1.7	1.8	2.0	2.0	2.0	2.0
			Bottom	18.4	18.3	18.3	8.4	8.4	8.4	32.7	32.7	32.7	7.1	7.4	7.3	95.9	97.1	96.5	2.0	2.0	2.0		2.0	2.0	2.0	
CF	11:23	18.5	Surface	18.4	18.5	18.5	8.4	8.5	8.5	32.8	32.7	32.8	7.3	7.7	7.5	98.5	96.8	97.7	2.0	2.0	2.0		2.0	2.0	2.0	
			Middle	18.4	18.6	18.5	8.4	8.4	8.4	32.9	32.6	32.7	7.2	7.6	7.4	97.7	95.6	96.7	2.0	2.0	2.0	1.9	2.0	2.0	2.0	2.0
			Bottom	18.4	18.3	18.3	8.4	8.5	8.4	32.8	32.8	32.8	7.1	7.4	7.3	96.1	96.2	96.2	1.6	1.7	1.7		2.0	2.0	2.0	

Remark or Observation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 27-Dec-14  
 Tide: Mid-Ebb  
 Weather: Cloudy  
 Sea Conditions: Moderate  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)				
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**	
CE	16:00	23.8	Surface	18.3	18.3	18.3	8.4	8.4	8.4	33.0	33.2	33.1	7.1	7.3	7.2	96.6	98.2	97.4	2.2	2.2	2.2		2.0	2.0	2.0		
			Middle	18.3	18.5	18.4	8.4	8.3	8.4	32.9	32.6	32.7	6.8	7.1	7.0	92.7	91.1	91.9	2.1	2.1	2.1	2.2	2.0	2.0	2.0	2.0	
			Bottom	18.3	18.4	18.4	8.4	8.5	8.5	32.9	32.6	32.7	6.8	7.0	6.9	92.1	93.5	92.8	2.3	2.2	2.3		2.0	2.0	2.0		
I1	16:43	13.2	Surface	18.4	18.4	18.4	8.5	8.5	8.5	32.9	32.7	32.8	6.9	7.2	7.1	94.2	94.0	94.1	5.7	5.6	5.7		2.0	2.0	2.0		
			Middle	18.4	18.3	18.3	8.5	8.4	8.5	32.9	33.0	32.9	6.9	7.1	7.0	93.9	95.8	94.9	3.3	3.4	3.4	3.8	2.0	2.0	2.0	2.0	
			Bottom	18.4	18.2	18.3	8.5	8.6	8.6	32.9	32.9	32.9	6.9	7.3	7.1	93.5	94.6	94.1	2.4	2.3	2.4		2.0	2.0	2.0		
I2	17:03	17.8	Surface	18.1	18.2	18.1	8.5	8.4	8.4	33.0	32.7	32.9	7.2	7.5	7.3	97.7	97.5	97.6	2.3	2.3	2.3		2.0	2.0	2.0		
			Middle	18.3	18.5	18.4	8.5	8.5	8.5	32.9	32.9	32.9	7.2	7.4	7.3	98.4	98.5	98.5	1.8	1.7	1.8	1.9	2.0	2.0	2.0	2.0	
			Bottom	18.3	18.3	18.3	8.5	8.4	8.5	32.9	32.9	32.9	7.0	7.3	7.1	95.1	94.9	95.0	1.7	1.7	1.7		2.0	2.0	2.0		
Intake A	17:24	9.4	Surface	18.3	18.1	18.2	8.5	8.6	8.6	32.9	33.0	33.0	7.3	7.6	7.4	99.3	100.5	99.9	2.3	2.3	2.3		2.0	2.0	2.0		
			Middle	18.3	18.3	18.3	8.5	8.5	8.5	32.9	32.8	32.8	7.2	7.6	7.4	97.7	97.2	97.5	2.1	2.0	2.1	2.2	2.0	2.0	2.0	2.0	
			Bottom	18.3	18.3	18.3	8.5	8.6	8.6	32.8	32.5	32.7	7.1	7.4	7.2	96.6	95.8	96.2	2.2	2.3	2.3		2.0	2.0	2.0		
Intake B	16:22	9.5	Surface	18.3	18.4	18.4	8.5	8.6	8.6	32.9	32.8	32.9	7.3	7.6	7.5	99.5	99.9	99.7	2.2	2.1	2.2		2.0	2.0	2.0		
			Middle	18.4	18.4	18.4	8.5	8.5	8.5	32.9	32.8	32.9	7.1	7.5	7.3	96.5	94.8	95.7	2.0	2.1	2.1	2.1	2.0	2.0	2.0	2.0	
			Bottom	18.4	18.2	18.3	8.5	8.5	8.5	32.9	33.1	33.0	6.9	7.4	7.2	94.3	92.8	93.6	1.9	2.0	2.0		2.0	2.0	2.0		

Remark or Observation: NIL

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 29-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)				Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**	
I1	12:21	13.5	Surface	18.1	18.2	18.2	8.4	8.5	8.5	32.4	32.6	32.5	7.7	7.7	7.7	99.3	98.0	98.7	2.0	2.1	2.1		3.0	3.0	3.0		
			Middle	18.1	18.1	18.1	8.4	8.4	8.4	32.5	32.2	32.4	7.7	7.7	7.7	98.8	100.5	99.7	1.7	1.7	1.7	1.9	2.0	4.0	3.0	3.0	
			Bottom	18.5	18.4	18.4	8.4	8.4	8.4	32.5	32.8	32.7	7.6	7.7	7.7	98.8	96.8	97.8	1.8	1.8	1.8		4.0	2.0	3.0		
I2	12:41	17.9	Surface	18.4	18.6	18.5	8.5	8.5	8.5	32.8	32.7	32.7	7.5	7.5	7.5	97.1	97.9	97.5	1.5	1.5	1.5		3.0	2.0	2.5		
			Middle	18.4	18.6	18.5	8.4	8.5	8.5	32.4	32.5	32.5	7.6	7.6	7.6	98.0	98.9	98.5	2.2	2.1	2.2	1.9	3.0	2.0	2.5	2.3	
			Bottom	18.4	18.3	18.4	8.4	8.3	8.3	32.6	32.6	32.6	7.5	7.6	7.6	97.3	96.4	96.9	2.1	2.1	2.1		2.0	2.0	2.0		
Intake A	13:02	9.5	Surface	18.2	18.1	18.1	8.4	8.4	8.4	32.4	32.3	32.3	7.7	7.7	7.7	98.8	99.2	99.0	1.7	1.8	1.8		4.0	2.0	3.0		
			Middle	18.3	18.1	18.2	8.5	8.4	8.4	32.7	32.9	32.8	7.7	7.7	7.7	99.3	100.4	99.9	2.0	1.9	2.0	1.9	3.0	2.0	2.5	2.5	
			Bottom	18.4	18.3	18.4	8.4	8.3	8.3	32.7	32.7	32.7	7.6	7.5	7.5	97.8	98.6	98.2	1.9	1.9	1.9		2.0	2.0	2.0		
Intake B	12:00	9.4	Surface	18.4	18.4	18.4	8.5	8.6	8.5	32.4	32.3	32.4	7.6	7.5	7.5	97.7	96.0	96.9	1.7	1.7	1.7		3.0	2.0	2.5		
			Middle	18.4	18.6	18.5	8.5	8.4	8.4	32.5	32.3	32.4	7.5	7.6	7.6	96.9	99.0	98.0	1.8	1.7	1.8	2.0	2.0	2.0	2.0	2.2	
			Bottom	18.4	18.2	18.3	8.5	8.5	8.5	32.7	32.7	32.7	7.6	7.5	7.6	98.7	99.4	99.1	2.6	2.7	2.7		2.0	2.0	2.0		
CF	13:23	18.1	Surface	18.1	18.3	18.2	8.5	8.5	8.5	32.7	32.8	32.7	7.5	7.5	7.5	97.0	97.0	97.0	1.8	1.8	1.8		2.0	3.0	2.5		
			Middle	18.2	18.2	18.2	8.4	8.3	8.3	32.4	32.3	32.3	7.7	7.6	7.7	99.3	97.6	98.5	1.8	1.9	1.9	1.8	2.0	3.0	2.5	2.5	
			Bottom	18.3	18.4	18.4	8.5	8.4	8.4	32.4	32.1	32.2	7.7	7.7	7.7	99.2	97.2	98.2	1.6	1.6	1.6		3.0	2.0	2.5		

Remark or Observation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 29-Dec-14

Tide: Mid-Ebb

Weather:

Sea Conditions:

Upstream Control Station: CE

Remark or Obsevation: Mid-ebb on 29 Dec 2014 is beyond normal working hour; no monitoring on that tide was conducted

Note: \* Average

\*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 31-Dec-14  
 Tide: Mid-Flood  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CF

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
I1	14:21	13.4	Surface	19.2	19.2	19.2	8.4	8.3	8.4	32.8	32.5	32.7	8.1	8.3	8.2	106.7	105.4	106.1	2.5	2.4	2.5		2.0	2.0	2.0	
			Middle	19.1	19.0	19.0	8.3	8.4	8.4	32.5	32.6	32.6	7.8	7.8	7.8	102.5	101.1	101.8	2.5	2.6	2.6	2.3	3.0	3.0	3.0	2.5
			Bottom	19.2	19.0	19.1	8.4	8.4	8.4	32.7	32.8	32.7	7.7	7.7	7.7	100.5	99.6	100.1	1.9	1.9	1.9		3.0	2.0	2.5	
I2	14:41	18.0	Surface	19.1	19.1	19.1	8.4	8.3	8.4	32.6	32.6	32.6	7.5	7.6	7.5	97.7	95.6	96.7	1.8	1.8	1.8		2.0	2.0	2.0	
			Middle	19.0	19.1	19.1	8.4	8.4	8.4	32.4	32.5	32.5	7.4	7.5	7.5	97.0	95.6	96.3	2.0	2.0	2.0	2.0	3.0	3.0	3.0	2.5
			Bottom	19.0	19.0	19.0	8.3	8.2	8.2	32.7	32.9	32.8	7.5	7.3	7.4	97.9	98.3	98.1	2.3	2.3	2.3		3.0	2.0	2.5	
Intake A	15:02	9.3	Surface	19.2	19.2	19.2	8.4	8.3	8.3	32.4	32.5	32.5	7.4	7.4	7.4	97.5	97.0	97.3	2.2	2.3	2.3		3.0	3.0	3.0	
			Middle	18.9	18.7	18.8	8.3	8.3	8.3	32.7	32.7	32.7	7.5	7.5	7.5	98.2	98.1	98.2	2.1	2.1	2.1	2.1	2.0	2.0	2.0	2.3
			Bottom	18.9	19.0	18.9	8.3	8.3	8.3	32.7	32.5	32.6	7.4	7.3	7.3	96.5	97.6	97.1	2.0	2.0	2.0		2.0	2.0	2.0	
Intake B	14:00	9.2	Surface	18.9	19.0	18.9	8.3	8.3	8.3	32.7	32.6	32.7	7.2	7.2	7.2	93.9	94.6	94.3	3.0	3.1	3.1		2.0	2.0	2.0	
			Middle	19.2	19.1	19.1	8.5	8.4	8.4	32.4	32.2	32.3	7.4	7.6	7.5	97.1	96.9	97.0	2.1	2.1	2.1	2.4	3.0	2.0	2.5	2.2
			Bottom	19.2	19.1	19.2	8.5	8.5	8.5	32.7	32.5	32.6	7.1	7.1	7.1	93.6	95.1	94.4	2.1	2.0	2.1		2.0	2.0	2.0	
CF	15:23	18.1	Surface	18.9	18.9	18.9	8.4	8.4	8.4	32.6	32.8	32.7	7.4	7.4	7.4	96.7	95.9	96.3	1.6	1.6	1.6		3.0	2.0	2.5	
			Middle	18.9	18.8	18.8	8.4	8.4	8.4	32.4	32.6	32.5	7.3	7.3	7.3	95.7	95.7	95.7	1.6	1.6	1.6	1.6	3.0	2.0	2.5	2.5
			Bottom	19.2	19.2	19.2	8.4	8.3	8.3	32.5	32.6	32.6	7.5	7.4	7.4	98.1	96.2	97.2	1.7	1.7	1.7		3.0	2.0	2.5	

Remark or Observation: NIL

Note: \* Average  
 \*\* Depth Average

SIL(E) Water Quality Monitoring Data Record Sheet

Date: 31-Dec-14  
 Tide: Mid-Ebb  
 Weather: Sunny  
 Sea Conditions: Calm  
 Upstream Control Station: CE

Location	Sampling Time	Water Depth (m)	Monitoring Depth	Temperature (°C)			pH			Salinity (ppt)			DO (mg/l)			DO Saturation (%)			Turbidity (NTU)				Suspended Solids (mg/l)			
				1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	1	2	Ave.*	D.A.**	1	2	Ave.*	D.A.**
CE	08:00	24.2	Surface	19.0	19.1	19.1	8.4	8.4	8.4	32.6	32.4	32.5	7.5	7.5	7.5	97.7	97.4	97.6	1.7	1.7	1.7		2.0	2.0	2.0	
			Middle	19.2	19.0	19.1	8.4	8.5	8.4	32.6	32.6	32.6	7.2	7.2	7.2	94.8	95.1	95.0	1.5	1.5	1.5	1.6	2.0	3.0	2.5	2.7
			Bottom	19.2	19.2	19.2	8.4	8.5	8.5	32.7	32.9	32.8	7.4	7.3	7.4	97.7	97.0	97.4	1.7	1.7	1.7		4.0	3.0	3.5	
I1	08:43	13.2	Surface	18.9	18.8	18.8	8.4	8.3	8.3	32.5	32.3	32.4	8.2	8.1	8.2	107.0	107.2	107.1	2.6	2.7	2.7		3.0	2.0	2.5	
			Middle	19.2	19.1	19.1	8.3	8.2	8.2	32.7	32.5	32.6	7.5	7.4	7.5	98.8	100.0	99.4	2.4	2.4	2.4	2.3	2.0	4.0	3.0	2.5
			Bottom	19.2	19.2	19.2	8.4	8.4	8.4	32.8	32.8	32.8	7.5	7.6	7.6	98.6	98.8	98.7	1.8	1.8	1.8		2.0	2.0	2.0	
I2	09:03	17.0	Surface	19.1	19.1	19.1	8.4	8.4	8.4	32.9	33.1	33.0	7.3	7.5	7.4	96.0	97.0	96.5	1.8	1.7	1.8		3.0	4.0	3.5	
			Middle	19.2	19.0	19.1	8.4	8.3	8.3	32.9	32.7	32.8	7.4	7.2	7.3	97.2	97.3	97.3	1.9	2.0	2.0	2.0	3.0	4.0	3.5	3.3
			Bottom	19.2	19.0	19.1	8.5	8.4	8.4	32.7	32.8	32.8	7.4	7.5	7.5	97.6	99.7	98.7	2.2	2.1	2.2		4.0	2.0	3.0	
Intake A	09:24	9.4	Surface	19.0	18.8	18.9	8.5	8.4	8.4	32.5	32.7	32.6	7.3	7.4	7.4	95.7	94.3	95.0	2.2	2.1	2.2		2.0	3.0	2.5	
			Middle	19.2	19.3	19.3	8.3	8.3	8.3	32.8	32.6	32.7	7.4	7.5	7.5	97.8	98.4	98.1	2.0	2.0	2.0	2.0	3.0	4.0	3.5	3.0
			Bottom	19.2	19.0	19.1	8.4	8.5	8.5	33.0	33.3	33.2	7.3	7.4	7.4	96.3	97.1	96.7	1.9	1.9	1.9		3.0	3.0	3.0	
Intake B	08:22	9.6	Surface	19.2	19.3	19.3	8.4	8.4	8.4	32.7	32.9	32.8	7.2	7.1	7.1	94.6	94.5	94.6	2.9	2.8	2.9		3.0	2.0	2.5	
			Middle	18.9	19.0	18.9	8.3	8.2	8.3	32.6	32.6	32.6	7.2	7.1	7.2	94.6	95.4	95.0	2.0	2.0	2.0	2.3	4.0	2.0	3.0	2.8
			Bottom	19.3	19.3	19.3	8.4	8.4	8.4	32.5	32.5	32.5	7.2	7.1	7.1	94.2	96.0	95.1	2.0	2.0	2.0		3.0	3.0	3.0	

Remark or Obsevation: NIL

Note: \* Average  
 \*\* Depth Average

## APPENDIX E

### Review of Exceedance in Environmental Monitoring

## APPENDIX E

### Review of Exceedance in Environmental Monitoring

Sampling Date	Sampling Station	Tidal Mode	Parameters of Exceedance			Remarks
			DO	Turbidity	SS	
1 Dec 2014	I1	Mid-Ebb	-	-	LL	As per the investigation, no marine work activity was carried out with no special incident and sign of sediment plume dispersion were observed during the monitoring. Silt curtain has been inspected and no abnormality was observed. As such, the natural fluctuation of the marine water quality has been considered attributed to such exceedance case. The exceedance was considered not related to the project works.
3 Dec 2014	Intake B	Mid-ebb			AL	As per investigation, SS levels at stations I1 and I2, which locate closer to the works area, were below the action levels as well as the levels at Intake B. No marine work activity was carried out with no special incident and sign of sediment plume dispersion were observed during the monitoring. Silt curtain has been inspected and no abnormality was observed. As such, the natural fluctuation of the marine water quality has been considered attributed to such exceedance case. The exceedance was considered not related to the project works.
10 Dec 2014	I2	Mid-flood		LL		As per investigation, Turbidity levels among all monitoring stations were nearly the same, i.e. 5 NTU. No marine work activity was carried out with no special incident and sign of sediment plume dispersion were observed during the monitoring. Silt curtain has been inspected and no abnormality was observed. As such, the natural fluctuation of the marine water quality has been considered attributed to such exceedance case. The exceedance was considered not related to the project works.

*Note:* AL – Action Level; LL – Limit Level

*Remarks:*

## APPENDIX F

### Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<b>Noise Impact (Construction Phase)</b>								
<i>Airborne</i>								
3.4.1.4	2	<b>Adoption of Quieter PME</b> The recommended quieter PME adopted in the assessment were taken from the BS5228: Part 1:2009 and are presented in <b>Table 3.20</b> . It should be noted that the silenced PME selected for assessment can be found in Hong Kong.	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIAO and NCO	Being implemented
3.4.1.4	2	<b>Use of Movable Noise Barrier</b> The use of movable barrier for certain PME can further alleviate the construction noise impacts. In general, a 5 dB(A) reduction for movable PME and 10 dB(A) for stationary PME can be achieved depending on the actual design of the movable noise barrier. The Contractor shall be responsible for design of the movable noise barrier with due consideration given to the size of the PME and the requirement for intercepting the line of sight between the NSRs and PME. Barrier material with surface mass in excess of 7 kg/m <sup>2</sup> is recommended to achieve the predicted screening effect.	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIAO and NCO	Being implemented
3.4.1.4	2	<b>Use of Noise Enclosure/ Acoustic Shed</b> The use of noise enclosure or acoustic shed is to cover stationary PME such as air compressor and concrete pump. With the adoption of the noise enclosure, the PME could be completely screened, and noise reduction of 15 dB(A) can be achieved according to the GW-TM.	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIAO and NCO	Being implemented
3.4.1.4	2	<b>Use of Silencer</b> To reduce noise emission from the ventilation fans, silencers are also recommended to be used in fan ventilation system to attenuate noise generated during fan operation to achieve a noise reduction of 15 dB(A).	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIAO and NCO	Being implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
3.4.1.4	2	<p><b>Use of Noise Insulating Fabric</b></p> <p>Noise insulating fabric (the Fabric) can also be adopted for certain PME (e.g. drill rig, piling auger etc). The Fabric should be lapped such that there are no openings or gaps on the joints. Technical data from manufacturers state that by using the Fabric, a noise reduction of over 10 dB(A) can be achieved on noise level.</p>	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIAO and NCO	Being implemented
3.4.1.4	2	<p><b>Good Site Practice</b></p> <p>The good site practices listed below should be followed during each phase of construction:</p> <ul style="list-style-type: none"> <li>• Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme;</li> <li>• Silencers or mufflers on construction equipment should be utilized and properly maintained during the construction programme;</li> <li>• Mobile plant, if any, should be sited as far from NSRs as possible;</li> <li>• Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>• Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and</li> <li>• Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities.</li> </ul>	To minimize the construction air-borne noise impact	Contractors	Construction Work Sites	During Construction	EIAO and NCO	Being implemented
<i>Ground-borne</i>								
3.4.2.5	2	PME that is in intermittent use should be shut down between work periods or should be throttled down to a minimum.	To minimize the construction ground-borne noise impact	Contractors	Tunnel site near Lei Tung Station	During Construction	NCO	To be implemented as per construction programme

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<b>Noise Impact (Operation Phase)</b>								
<i>Airborne</i>								
<u>Railway Noise</u>								
3.5.1.1	2	Erection of noise barrier/ enclosure along the viaduct section as shown in <b>Table 3.52</b> and illustrated in <b>Figures 3.25 to 3.27</b> .  For the 'Further Mitigation Measures for Existing and Planned NSRs', additional noise barriers/semi-enclosures have been recommended for viaduct sections shown in <b>Table 3.57</b> and illustrated in <b>Figure 3.28 to 3.30</b> . The viaduct structure should allow further installation of noise barrier or enclosure at the later commissioning stage, if required.	To minimize the railway airborne noise along the viaduct section of SIL(E)	MTRC / Contractor	West of ex-Canadian Hospital site, West of Ocean Park G/IC site, East and West of Wong Chuk Hang Residential Zone, along Wong Chuk Hang Nullah and along Ap Lei Chau Bridge as shown in Figure 3.25 to Figure 3.30.	Before Operation	EIAO and NCO	To be implemented as per construction programme
<u>Fixed Plant Noise</u>								
3.5.1.2	2	The following noise reduction measures shall be considered as far as practicable during construction: <ul style="list-style-type: none"> <li>Choose quieter plant such as those which have been effectively silenced;</li> <li>Include noise levels specification when ordering new plant (including chillier and E/M equipment);</li> <li>Locate fixed plant/louver away from any NSRs as far as practicable;</li> <li>Locate fixed plant in walled plant rooms or in specially designed enclosures;</li> <li>Locate noisy machines in a basement or a completely separate building;</li> <li>Install direct noise mitigation measures including silencers, acoustic louvers and acoustic enclosure where necessary; and</li> <li>Develop and implement a regularly scheduled plant maintenance programme so that equipment is properly operated and serviced in order to maintain a controlled level of noise.</li> </ul>	To minimize the fixed plant noise impact	MTRC	All stations, entrances, and ventilation buildings	Before Operation	EIAO and NCO	To be implemented as per construction programme

## Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<i>Ground-borne</i>								
3.5.2.3	2	Using of incline turnout (a 5 dB(A) reduction in turnout and crossing vibration) and Type 1a resilient baseplated trackform within the SOH station.	To minimize the railway ground-borne noise impact	MTRC / Contractor	South Horizons Station	Before Operation	EIAO and NCO	To be implemented as per construction programme
<b>Ecological Impact (Construction Phase)</b>								
<i>Habitat Loss</i>								
4.7.1	3	Minimise habitat loss particularly woodland as far as possible.	Minimize habitat loss	Contractors	Construction Work Sites	During Construction	Annex 16 of EIAO-TM	Being implemented
4.7.1	3	Temporary disturbed woodland should be reinstated in full after the completion of works	To reinstate disturbed woodland habitats	Contractors	Construction Work Sites	After completion of construction works	Annex 16 of EIAO-TM; ETWB TCW No. 2/2004 (for maintenance arrangement of vegetation)	To be implemented as per construction programme
4.7.1	3	Degraded woodland and shrubland should be reinstated after the completion of works as far as possible.	To reinstate disturbed habitats	Contractors	Construction Work Sites	After completion of construction works	Annex 16 of EIAO-TM; ETWB TCW No. 2/2004 (for maintenance arrangement of vegetation)	To be implemented as per construction programme
4.7.1	3	Habitat Compensation of permanent loss of woodland in full in terms of area.	To compensate permanent loss of woodland	Contractors	Construction Work Sites	After completion of construction works	Annex 16 of EIAO-TM; ETWB TCW No. 2/2004 (for maintenance arrangement of vegetation)	To be implemented as per construction programme
<i>Ardeid Night Roost</i>								
4.7.2.1	3	<b>Avoidance of Site Clearance and Tree Felling Works at Wintering Season</b> Site clearance and tree felling works at the existing ardeid night roost (location described in <b>Figure 4.15</b> ) should only be carried out at non-wintering season (March to November inclusive). Demarcating clearly the works area and ensuring good site practise to avoid unnecessary disturbance to the ardeids during construction phase.	Avoid and minimize impact on peak period of ardeid roosting	Contractor	Construction Work Sites	During Construction	Annex 16 of EIAO-TM	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
4.7.2.1 and 4.7.2.4	3	<b>Compensate for loss of roosting trees with replanting of suitable trees</b> The compensatory planting with suitable, heavy standard trees should be located at the lower course of the WCH Nullah approximately 200m west of the existing night roost (location shown in <b>Figure 4.15</b> ). Trees should be replanted after construction alongside the nullah to provide a substrate for roosting.	To compensate for permanent loss of roosting trees	Contractors, advised by Ecologist	Construction Work Site at Wong Chuk Hang	After completion of construction works	Annex 16 of EIAO-TM; ETWB TCW No. 2/2004 (for maintenance arrangement of vegetation)	To be implemented as per construction programme
4.7.2.1	3	<b>Inspection of ardeid night roost for active ardeid nests</b> When conducting site clearance works at the existing ardeid night roost, the area should be inspected to confirm no active ardeid nest are present. If any active bird nest is observed, suitably sized buffer area should be established to minimize human or machinery disturbance until the nest is abandoned. Also the site should be monitored monthly to check the updated status.	Ensure no impact on active ardeid nests	Contractors, advised by Ecologist	Construction Work Site at Wong Chuk Hang	During Construction	Wild Animals Protection Ordinance (Cap. 170)	Being implemented
4.7.2.2	3	<b>Avoidance of Construction Activities at Sunset Time</b> Construction activities using PME at the potential ardeid night roost (location shown in <b>Figure 4.13</b> ) should be ceased at 18:00 – 06:00 to avoid disturbance to the night roost ardeids.	Minimize noise impact on ardeid roosting and foraging	Contractor	Construction Work Sites	During Construction	Annex 16 of EIAO-TM	Being implemented
4.7.2.4	3	<b>Coloured Panels on Noise Barriers</b> The acoustic enclosure/ barrier should be designed with coloured panels to minimize the chance of bird collision.	To minimise the potential for bird strike	Contractors	Construction Work Sites	During Construction	Annex 16 of EIAO-TM;	To be implemented as per construction programme
4.7.3	3	<b>Magazine Site</b> Implement good site practice including containment of silt runoff within the site boundary, containment of contaminated soils, appropriate storage of chemicals and wastes.	Avoid impacts to fauna species and water pollution	Contractor	Chung Hom Shan Magazine Site	During Construction	ProPECC Note PN 1/94 Waste Disposal Ordinance (Cap.354)	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
4.7.4	3	<b>Coral Community at Aberdeen Channel</b> A bridge pier construction method in which a cofferdam would be installed to create a confined dredging environment should be implemented to minimise potential impacts from suspended solid release. Good site practices should be applied to land-based construction works including containment of silt runoff within the site boundary, the containment of contaminated soils for removal from the site and appropriate storage of chemicals and chemical waste.	Avoid release of suspended solid and contaminated runoff to Aberdeen Channel	Contractors	Dredging/ excavation area required for installation of the pier/pier foundations of bridge in Aberdeen Channel	During marine construction works	WQOs & ProPECC Note PN 1/94	Implemented
4.7.5	3	<b>Floral Species of Conservation Interest</b> Transplanting all affected floral species of conservation interest identified in the EcolA. <i>In-situ</i> preservation should be re-considered throughout all stages of the project.	Mitigate the removal impact on floral species of conservation interest	Contractors	Construction Work Sites	During Construction	Annex 16 of EIAO-TM;	Being implemented
<b>Water Quality Impact (Construction)</b>								
5.7.1.1	4	<b>Dredging/ Excavation and Seawall modification for construction of piers/pier foundations of bridge in Aberdeen Channel</b> To minimise the loss of fine sediment to suspension, steel pile casing and watertight cofferdam should be installed and seawater trapped inside the casing and cofferdam should be pumped out to generate a dry working environment prior to carrying out sediment dredging/ excavation. The water from the dewatering should be appropriately treated with desilting or sedimentation device before discharge. Silt curtains should be deployed to completely enclose the cofferdam installation and removal works and the seawall modification and pile installation works respectively.	Avoid spillage of sediment	MTRC / Contractor	Dredging/ excavation area required for installation of the pier/pier foundations of bridge in Aberdeen Channel	During marine construction works	WQOs & ProPECC Note PN 1/94	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
5.7.1.2	4	<p><b>Barging Facilities and Activities</b></p> <p>To minimise the release of suspended solids to marine waters, silt curtain should be deployed to completely enclose the marine piles works during installation and decommissioning. Good site practices for operation of barging points should be followed, including appropriate sizing of vessels to ensure adequate clearance between the vessel and the seabed, controlled loading and unloading of barges and hoppers to prevent splash, installing tight fitting seals to the bottom openings to prevent leakage, and measures to prevent foam, oil, grease, scum or litter on the water within the site.</p>	To minimize suspended solids and water quality impacts	MTRC / Contractor	Barging point marine works area	During marine construction works	WQOs & ProPECC Note PN 1/94	Being implemented
5.7.1.3	4	<p><b>Sewage Effluent from Construction Workforce</b></p> <p>Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.</p>	To minimize water quality impacts	MTRC / Contractor	All works areas with on-site sanitary facilities	During Construction	Water Pollution Control Ordinance	Being implemented
5.7.1.4	4	<p><b>Wastewater Discharge from Tunnelling and Open Cut Excavation</b></p> <p>Wastewater with a high level of suspended solids should be treated before discharge by settlement in tanks with sufficient retention time. Oil interceptors would be required to remove the oil, lubricants and grease from wastewater. Should the level of suspended solids be very high, an on-site pre-packaged treatment plant might be required with the addition of flocculants to improve the settlement of solids. A discharge licence under the WPCO would be required for discharge to stormwater drain.</p>	To minimize water quality impacts	MTRC / Contractor	All works areas	During Construction	Water Pollution Control Ordinance	Being implemented
5.7.1.5	4	<p><b>Construction Site Runoff and Drainage</b></p> <p>The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended to protect water quality and sensitive uses of the coastal area i.e. WSD seawater intakes along the Aberdeen Channel:</p>	To minimize water quality impacts	MTRC / Contractor	All works areas	During Construction	ProPECC Note PN 1/94	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
		<ul style="list-style-type: none"> <li>At the start of site establishment (including the barging facilities), perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system should be undertaken by the Contractor prior to the commencement of construction.</li> <li>The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into stormwater drainage system through a sediment/silt trap. The sediment/silt traps should be incorporated in the permanent drainage channels to enhance deposition rates, if practical.</li> <li>Sand/silt removal facilities such as sand/silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the TM standards under the WPCO. The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending upon the flow rate. The detailed design of the sand/silt traps should be undertaken by the Contractor prior to the commencement of construction.</li> </ul>						

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
		<ul style="list-style-type: none"> <li>• All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be regularly removed, at the onset of and after each rainstorm to ensure that these facilities are functioning properly at all times.</li> <li>• Measures should be taken to minimize the ingress of site drainage into excavations. If excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from foundation excavations should be discharged into storm drains via silt removal facilities.</li> <li>• If surface excavation works cannot be avoided during the wet season (April to September), temporarily exposed slope/soil surfaces should be covered by tarpaulin or other means, as far as practicable, and temporary access roads should be protected by crushed stone or gravel, as excavation proceeds. Interception channels should be provided (e.g. along the crest/edge of the excavation) to prevent storm runoff from washing across exposed soil surfaces.</li> <li>• The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows.</li> </ul>						

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
		<ul style="list-style-type: none"> <li>• All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exit where practicable. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains.</li> <li>• Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system.</li> <li>• Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and stormwater runoff being directed into foul sewers.</li> <li>• Precautions should be taken at any time of the year when rainstorms are likely. Actions should be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC Note PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes.</li> </ul>						

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
		<ul style="list-style-type: none"> <li>Bentonite slurries used in piling or slurry walling should be reconditioned and reused wherever practicable. Temporary enclosed storage locations should be provided on-site for any unused bentonite that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.</li> </ul>						
5.7.1.6	4	<p><b>General Construction Activities</b></p> <p>Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used.</p> <p>Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event.</p>	To minimize water quality impacts	MTRC / Contractor	All works areas	During Construction	EIA Recommendation	Being implemented
<b>Water Quality Impact (Operation)</b>								
5.7.2.1	4	<p><b>Change in flow regime and hydrology in Aberdeen Channel (Typhoon Shelter) (ATS) due to railway bridge</b></p> <p>Streamline shaped bridge pier to reduce friction to the tidal flows across the Aberdeen Channel should been considered in the conceptual design of the bridge form.</p>	To minimize water quality impacts	MTRC / Detailed Design Consultant	Pier/pier foundations of bridge in Aberdeen Channel	During Detailed Design	EIA Recommendation	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
5.7.2.3	4	<p><b>Sewage and wastewater effluents from stations and depot</b></p> <ul style="list-style-type: none"> <li>• Runoff and spillage prevention measures should conform to relevant engineering and design standards. Any opportunities for the recycling of water within the automatic washing facilities should be sought to minimise discharge requirements. Bio-degradable detergents should be selected to minimise the impact on water quality and associated ecosystems of the receiving water bodies.</li> <li>• Plant maintenance areas should be bunded and constructed on an impermeable floor, and provided with petrol interceptors. Traps and interceptors should be regularly cleaned and maintained, especially after any accidental spillages. Layers of sawdust, sand or equivalent material should be laid underneath and around any plant and equipment that may possibly leak oil.</li> <li>• An emergency spillage action plan should be developed for the Depot to ensure that any accidental spillage event is treated immediately and does not impact on any water bodies.</li> <li>• All fuel tanks and storage areas within the Depot should be provided with locks and be located on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank, to prevent the escape of spilled fuel oils.</li> <li>• Waste oil and other chemicals must be disposed by a licensed contractor to either the approved Chemical Waste Treatment Centre, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation (Cap 354).</li> </ul>	To minimize water quality impacts	MTRC	SIL(E) Stations & WCH Depot	During Operation	WPCO	To be implemented as per construction programme

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
5.7.2.4	4	<p><b>Runoff from rail tracks</b></p> <ul style="list-style-type: none"> <li>Track drainage channels discharge should pass through oil/grit interceptors/chambers to remove oil, grease and sediment before being pumped to the public stormwater drainage system.</li> <li>Silt traps and oil interceptors should be cleaned and maintained regularly.</li> <li>Oily contents of the oil interceptors should be transferred to an appropriate disposal facility, or to be collected for reuse, if possible.</li> </ul>	To minimize water quality impacts	MTRC	Along the SIL(E) tracks	During Operation	WPCO	To be implemented as per construction programme
<b>Landscape and Visual Impact (Construction Phase)</b>								
Table 6-13	<b>Preservation of Existing Vegetation</b>							
CP1.1	5	To retain trees, which have high amenity or ecology value and contribute most to the landscape and visual amenity of the site and its immediate environs.	To minimise the disturbance to the existing landscape resources.	Project Landscape Architect (Detailed Design Consultants)/ Contractor	Site	Throughout design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Implemented
CP1.2	5	Creation of precautionary area around trees to be retained equal to half of the trees canopy diameter. Precautionary area to be fenced.	To ensure the success of the tree preservation proposals.	Contractor	Site	Before construction phase commence	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Implemented
CP1.3	5	Prohibition of the storage of materials including fuel, the movement of construction vehicles, and the refuelling and washing of equipment including concrete mixers within the precautionary area.	To ensure the success of the tree preservation proposals.	Contractor	Site	Throughout construction phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP1.4	5	Phased segmental root pruning for trees to be retained and transplanted over a suitable period (determined by species and size) prior to lifting or site formation works which affect the existing rootball of trees identified for retention. The extent of the pruning will be based on the size and the species of the tree in each case.	To ensure the success of the tree preservation proposals.	Contractor	Site	Throughout construction phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP1.5	5	Pruning of the branches of existing trees identified for transplantation and retention to be based on the principle of crown thinning maintaining their form and amenity value.	To ensure the success of the tree preservation proposals.	Contractor	Site	Throughout construction phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
CP1.6	5	The watering of existing vegetation particularly during periods of excavation when the water table beneath the existing vegetation is lowered.	To ensure the success of the tree preservation proposals.	Contractor	Site	Throughout construction phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP1.7	5	The rectification and repair of damaged vegetation following the construction phase to it's original condition prior to the commencement of the works or replacement using specimens of the same species, size and form where appropriate to the design intention of the area affected	To ensure the success of the tree preservation proposals.	Contractor	Site	Throughout construction phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	To be implemented as per construction programme
CP1.8	5	All works affecting the trees identified for retention and transplanted will be carefully monitored. This includes the key stages in the preparation of the trees, the implementation of protection measures and health monitoring through out the construction period	To ensure the success of the tree preservation proposals.	Contractor	Site	Throughout construction phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP1.9	5	Detailed landscape and tree preservation proposals will be submitted to the relevant government departments for approval under the lease conditions and in accordance with ETWB TCW No. 2/2004 and 3/2006.	To ensure the tree preservation and planting proposals are integrated with the existing landscape context and that the landscape resources are preserved where appropriate.	Project Landscape Architect (Detailed Design Consultants)	Site	Throughout design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Implemented
CP1.10	5	The tree preservation works should be implemented. A tree protection specification would be included within the contract documents.	To ensure the tree preservation and planting proposals are integrated with the existing landscape context and that the landscape resources are preserved where appropriate.	Project Proponent	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Implemented
Table 6-13	<b>Works Area and Temporary Works Areas</b>							
CP2.1	5	Where appropriate to the final design the landscape of these works areas should be restored following the completion of the construction phase.	To minimise the disturbance to existing landscape resources and change of visual amenity.	Contractor	Site	Through out construction phase	TM-EIA Annex 18	To be implemented as per construction programme

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
CP2.2	5	Construction site controls should be enforced including the storage of materials, the location and appearance of site accommodation and the careful design of site lighting to prevent light spillage.	To minimise the disturbance to existing landscape resources and change of visual amenity.	Contractor	Site	Through out construction phase	TM-EIA Annex 18	Being implemented
CP2.3	5	Screen the works area during the construction phase through the use of decorative hoarding along the site boundary facing adjacent VSRs	To minimise the disturbance to existing landscape resources and change of visual amenity.	Contractor	Site	Through out construction phase	TM-EIA Annex 18	Being implemented
Table 6-13	<b>Implementation of Mitigation Planting and planting species selection</b>							
CP3.1	5	Replanting of disturbed vegetation should be undertaken at the earliest possible stage of the construction phase.	To minimise the disturbance to existing landscape resources and minimize the impacts on the visual amenity of the area.	Contractor	Site	After the site formation and on completion of planting area.	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP3.2	5	Use of native plant species predominantly in the planting design for the buffer areas.	To enhance the local landscape and ecological value.	Project Landscape Architect (Detailed Design Consultants)	Site	After the site formation and on completion of planting area.	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP3.3	5	Proposed mitigation planting shall not only limit to conventional amenity planting, but also considered alternative greening measures such as vertical greening for screening or soften the built structures. Small shrubs, climbing plants, grass and groundcovers shall be used in specific locations according to site condition and at where would not interfere the operation of railway and its associated facilities.	To maximise the planting opportunities	Project Landscape Architect (Detailed Design Consultants)	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP3.4	5	The tree planting works should be implemented by approved Landscape Contractors and inspected and approved on site by a qualified Landscape Architect. A tree planting specification would be included within the contract documents.	To ensure the tree preservation and planting proposals are integrated with the existing landscape context and that valuable landscape	Project Proponent	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
Table 6-13		<b>Transplantation of Existing Trees</b>						
CP4.1	5	The tree transplanting works should be implemented by approved Landscape Contractors and inspected and approved on site by a qualified Landscape Architect. A tree protection / transplanting specification would be included within the contract documents.	To ensure the tree preservation and planting proposals are integrated with the existing landscape context and that valuable landscape resources are preserved where appropriate to the final design.	Project Proponent / Contractor	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP4.2	5	Approximately 437 existing trees to be transplanted, majority of them shall be relocated to off-site planting areas. The final recipient sites should be, as far as space allows, adjacent to their current locations alongside of the alignment.	To retain their contribution to the local landscape context.	Project Landscape Architect (Detailed Design Consultants)/ Contractor / Project Proponent (planting areas associated with station and alignment)/ LCSD (roadside and park areas)	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP4.3	5	Tree to be transplanted to planting areas identified in the "Southern District Greening Master Plan" shall be, as far as programme allows, directly relocated to their final recipient sites.	To minimise the disturbance to the landscape resources.	Project Landscape Architect (Detailed Design Consultants)/ Contractor / Project Proponent (planting areas associated with station and alignment)/ LCSD (roadside and park areas)	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP4.4	5	Tree to be replanted along the alignment shall be kept in the temporary holding nurseries which closely monitoring by landscape contractor.	To enhance the survivals of the transplanted trees	Project Landscape Architect (Detailed Design Consultants)/ Contractor	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
CP4.5	5	The implementation programme for the proposed works should reserve enough time for the advance tree transplanting preparation works.	To enhance the survivals of the transplanted trees	Project Proponent/ Project Landscape Architect (Detailed Design Consultants)/ Contractor	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP4.6	5	The implementation programme for the proposed works should reserve enough time for the advance tree transplanting preparation works.	To enhance the survivals of the transplanted trees	Project Proponent/ Project Landscape Architect (Detailed Design Consultants)/ Contractor	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
CP4.7	5	The tree transplanting works should be implemented by approved Landscape Contractors and inspected and approved on site by a qualified Landscape Architect. A tree protection specification would be included within the contract documents.	To enhance the survivals of the transplanted trees	Project Proponent/ Project Landscape Architect (Detailed Design Consultants)/ Contractor	Site	Throughout design and construction phases	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004	Being implemented
Table 6-13	<b>Coordination with Concurrent Projects</b>							
CP5.1	5	Coordinated implementation programme with concurrent projects	To minimise potential impact where possible reduce the period of disturbance.	Project Proponent / Project Landscape Architect (Detailed Design Consultants)/ Contractor	Site	Throughout design and construction phases	TM-EIA Annex 18.	Being implemented
<b><u>Landscape and Visual Impact (Operation Phase)</u></b>								
Table 6-14	<b>Design of Engineering and Building Structures</b>							
OP1.1	5	Where possible integrate the engineering and building structures, as far as technically feasible, with existing built structures. Select responsive The locations for the associated facilities away from landscape and visually sensitive areas.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	To be implemented as per construction programme

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
OP1.2	5	Use of a responsive design for the disposition of the main elements including the locations of the proposed above ground structures.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout Design phase	TM-EIA Annex 18 and BD	To be implemented as per construction programme
OP1.3	5	The disposition and height profile of the proposed ground structures should respond to the existing context.	To enhance the sense of visual integration with the existing context, avoid abrupt transitions between the existing and proposed built environment and reduce the apparent visual mass of the proposed developments.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	To be implemented as per construction programme
OP1.4	5	Creation of setbacks, articulating the development frontage, maintenance of view corridors and the utilisation of stepped or articulated height profile.	To enhance the sense of visual integration with the existing context, avoid abrupt transitions between the existing and proposed built environment and reduce the apparent visual mass of the proposed developments.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented
OP1.5	5	Use of natural materials such as colour blocking, innovative surface treatments and vertical greening.	To reduce the apparent visual mass of the facilities.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18, HKPSG and BD	Implemented
OP1.6	5	Use of natural materials such as colour blocking, innovative surface treatments and vertical greening.	To reduce the apparent visual mass of the facilities.	Project Engineer and Architect (Detailed Design Consultants)/ Project Proponent	Site	Throughout design phase	TM-EIA Annex 18, HKPSG and BD	Implemented
OP1.7	5	Use of natural tones colour palette and non-reflective materials for outward facing building facades finishes.	To reduce the potential glare effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18, HKPSG and BD	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
OP1.8	5	Incorporation of landscaped terraced edges where conditions allow particularly those fronting the public realm.	To reduce the apparent visual mass of the structure and create a more subtle transition with the pedestrian level streetscape.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18, HKPSG and BD	Implemented
OP1.9	5	Aesthetic design of architectural and track lighting shall follow the following design intention. - Directional and full cut off lighting is recommended particularly for recreation and roadside areas; - Minimize geographical spread of lighting, only applied for safety at the key access points and staircases; - Limited lighting intensity to meet the minimum safety and operational requirement; and - High-pressure sodium road lighting is recommended for more stringent light control.	To reduce the night-time glare effect to the surrounding environs, reducing spillage and thus visual impacts.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Through out operation phase	TM-EIA Annex 18	To be implemented as per construction programme
Table 6-14		<b>Roadside and Amenity Planting</b>						
OP2.1	5	Utilise large ornamental trees to maximise the area of visible greenery, soften the interface between the proposed scheme and adjacent urban fabric and enhance the thermal comfort of adjacent spaces.	Provide a linkage with the existing landscape creating a more coherent landscape framework.	Project Landscape Architect(Detailed Design Consultants)/ Project Proponent	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG and BD	To be implemented as per construction programme
OP2.2	5	Planting proposals should respond to the need for visual access in the views from the adjacent neighbourhoods to the roadside or rural landscape. Whereas dense foliage plants shall be provided at other locations to screen and frame views, provide a more shaded environment for pedestrians and provide accents within the existing roadside planting.	Conserve and enhance the landscape interest.	Project Landscape Architect(Detailed Design Consultants)/ Project Proponent	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG and BD	Implemented
OP2.3	5	The planting on sloping ground and areas adjacent to existing woodland shall utilise native species.	Improving the ecological connectivity between existing woodland habitats and creating a more unified and coherent landscape framework.	Project Landscape Architect(Detailed Design Consultants)/ Project Proponent	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG and BD	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
Table 6-14		<b>Compensatory Planting Proposals</b>						
OP3.1	5	Utilise all available spaces for new tree and shrub planting to screen views of the proposals and where this is not possible soften their architectural form.	To soften the architectural form and enhance their visual integration within the future landscape context.	Project Landscape Architect (IDC Consultants) / LCSD	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG and BD	Implemented
OP3.2	5	New tree planting will be concentrated in the proposed amenity areas along the alignment and surrounding the stations, and providing infill planting between the retained and transplanted trees; and on the disturbed slope areas.	To restore and enhance existing landscape context.	Project Proponent / NA	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG and BD	Implemented
OP3.3	5	The preliminary planting proposals for the proposed works shall adopt a compensatory planting ratio of 1:1 (new planting: trees recommended for felling) utilising a combination of mature to light standard sized stock in general roadside and planting areas adjacent to proposed stations and above ground structures.	To compensate the loss of existing trees.	Project Proponent / Project Landscape Architect (IDC Consultants)	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG	Implemented
OP3.4	5	The retention of existing trees through their preservation in-situ, the transplantation of trees found to be in conflict with the proposed works and the successful establishment of the newly planted trees will form part of the roadside and slope planting enhancing the amenity of the local areas and providing for the thermal comfort of pedestrians.	To compensate the loss of existing trees.	Project Proponent / Project Landscape Architect (IDC Consultants)	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG	Implemented
OP3.5	5	The proposed compensatory and new tree planting will utilise a combination of species native to Hong Kong and ornamental feature trees for the slope areas and those alongside the infrastructure corridors. The species selection for the areas adjacent to proposed stations and within the main urban areas will utilise a range of amenity tree species. These proposals will be subject to further development during the detailed design stage of the project.	To compensate the loss of existing trees.	Project Proponent / Project Landscape Architect (IDC Consultants)	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG	Implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
OP3.6	5	The preliminary planting proposals for the proposed works shall adopt a compensatory planting ratio of 1:1 (new planting: trees recommended for felling) utilising a combination of mature to light standard sized stock in general roadside and planting areas adjacent to proposed stations and above ground structures.	To compensate the loss of existing trees.	Project Proponent / Project Landscape Architect (IDC Consultants)	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG	Implemented
OP3.7	5	The retention of existing trees through their preservation in-situ, the transplantation of trees found to be in conflict with the proposed works and the successful establishment of the newly planted trees will form part of the roadside and slope planting enhancing the amenity of the local areas and providing for the thermal comfort of pedestrians.	To compensate the loss of existing trees.	Project Proponent / Project Landscape Architect (IDC Consultants)	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG	Implemented
OP3.8	5	The proposed compensatory and new tree planting will utilise a combination of species native to Hong Kong and ornamental feature trees for the slope areas and those alongside the infrastructure corridors. The species selection for the areas adjacent to proposed stations and within the main urban areas will utilise a range of amenity tree species. These proposals will be subject to further development during the detailed design stage of the project.	To compensate the loss of existing trees.	Project Proponent / Project Landscape Architect (IDC Consultants)	Site	Through out design phase	TM-EIA Annex 18, ETWB TCW No. 3/2006 & 2/2004, HKPSG	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
Table 6-14	5	<p><b>Treatment of Retaining Wall and Slopes</b></p> <p>The proposed treatment of Retaining Wall and Slopes should be aesthetically enhanced through the use of soft landscape works including tree and shrub planting to give man-made slopes a more natural appearance blending into the local rural landscape.</p>	<p>The design seeks to visually integrate the engineered slope feature within the local landscape context.</p>	<p>Project Landscape Architect(Detailed Design Consultants)/ / LCSD or HyD</p>	Site	<p>Through out design phase</p>	<p>TM-EIA Annex 18, HKPSG and BD GEO Publication No. 1/2000 "Technical Guidelines on Landscape Treatment and Bio-engineering for Man-made Slopes and Retaining Walls" For HyD SIMAR slopes refer to Standard Requirements for Handover of Vegetation on to Highways Department (Rev.B).</p>	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
OP4.2	5	Whip sized tree planting is preferred on the face of soil cut slopes and at the crest and toe of the slope, and within berm planters. The smaller, younger plant stock will adapt to their new growing conditions more quickly than larger sized stock and establish a naturalistic effect more rapidly.	The design seeks to visually integrate the engineered slope feature within the local landscape context.	Project Landscape Architect(Detailed Design Consultants)/ / LCSD or HyD	Site	Through out design phase	TM-EIA Annex 18, HKPSG and BD GEO Publication No. 1/2000 "Technical Guidelines on Landscape Treatment and Bio-engineering for Man-made Slopes and Retaining Walls" For HyD SIMAR slopes refer to Standard Requirements for Handover of Vegetation on to Highways Department (Rev.B).	Implemented
<b>Table 6-14 Design of Noise Mitigation Structures</b>								
OP5.1	5	Noise mitigation structures installed along the trackside should not be limited to the functional requirements of mitigating train noise. It should also include a requirement that these structures make a positive contribution to the urban / semi-rural landscape character of this area and by doing so improve the perceived landscape quality of the area. These barriers would be visible from some VSRs identified in the study.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented
OP5.2	5	Promote the innovative use of materials, such as Plexiglas, fibreglass, reinforced concrete etc, whilst remaining aware of the design life span of each of the elements incorporated in the design.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
OP5.3	5	Reduce the visual effect of the structure through the use of form, materials, textures colours and tones.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented
OP5.4	5	Incorporation of articulation in the façade of the noise barriers / enclosures through the use of some transparent sections near the upper portion of the proposed structure.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented
OP5.5	5	Reflect the chromatic context of the surrounding urban landscape through the use of colour panels in the proposed noise barrier.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented
OP5.6	5	Utilise materials, which are non-reflective avoiding glare from incident sunlight.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD	Implemented
Table 6-14	<b>Design of Engineering Structures</b>							
OP6.1	5	The landscape consultants have worked in unison with the engineers on the aesthetic aspects of the structures and their relationship with the landscape.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Landscape Architects (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented
OP6.2	5	The structures shall aim to “touch” the ground as lightly as possible in order to minimise disturbance to the existing landscape and vegetation below the structures. This would be achieved by designing slender, rounded columns spaced the maximum distance apart. The viaducts would be constructed using pre-cast methods and launched from columns rather than scaffolding. The viaduct should be designed to achieve where appropriate a graceful, curving alignment.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
OP6.3	5	Landform and vegetation in areas disturbed by construction works would be reinstated to blend with the existing landscape patterns or as discussed above.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented
OP6.4	5	Wherever light levels, the water regime and the requirements of the ecological mitigation measures permit, vegetation would be reinstated below the structures. Irrigation may be required in some locations and hard landscape solutions considered where the clearance is low. Planting would be used wherever possible to minimise the apparent height of structures and to soften their appearance in medium and long distance views.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented
OP6.2	5	The design of the proposed structures should avoid unnecessary visual clutter, this would be achieved through the co-ordination of the various engineering disciplines involved to arrive at innovative design solutions.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented
OP6.5	5	Fair faced concrete would not be used for parapets to minimise glare from the structure and to avoid the visually detracting effect of staining.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented
OP6.6	5	Drainage structures would where possible be concealed within the structure of the proposed viaducts.	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Architect (Detailed Design Consultants)/ NA	Site	Throughout design phase	TM-EIA Annex 18 and BD, ACABAS	Implemented
Table 6-14	<b>Reinstatement and Creation of Open Spaces and Gardens</b>							
OP7.1	5	The landscape consultants have worked in unison with the engineers on the aesthetic aspects for Reinstatement and Creation of Open Spaces and Gardens	To ensure the proposals are integrated with the existing landscape and visual context, and avoid cluster effect.	Project Engineer and Landscape Architects (Detailed Design Consultants)/ NA	Site	Throughout Design and Construction phases	TM-EIA Annex 18 and BD, ACABAS	Implemented

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<b>Hazard to Life</b>								
A7A	6	Improved truck design to reduce the amount of combustibles in, front exhaust spark arrester, 1 x 9 kg water based and 1 x 9 kg dry chemical powder fire extinguishers for a vehicle with gross weight up to 9 tonnes, and 2 x 2.5kg dry powder and 2 x 10-litre foam fire extinguishers to be provided for a vehicle of 9 tonnes and above, and a hand-held lightning detector to be provided in the vehicle. This should be combined with monthly vehicle inspection.	To meet the ALARP requirement	MTRC/ Contractor	Explosive Magazine	Construction phase		To be implemented as per construction programme
A7A	6	Blasting activities including storage and transport of explosives should be supervised and audited by competent site staff to ensure strict compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives storage and transport would not be unacceptable	MTRC / Contractor	Works areas at which explosives would be stored and/or used	Construction phase	Dangerous Goods Ordinance	To be implemented as per construction programme
A7A	6	Only the required quantity of explosives for a particular blast should be transported to avoid the return of unused explosives to the magazine. The number of return trips to the magazine with the full load of explosives or partial load should be minimised by proper co-ordination between blasting and delivery. If disposal is required for small quantities, disposal should be made in a controlled and safe manner by a Registered Shotfirer.	To reduce the risk during explosives transport	MTRC/ Contractor	Works areas at which explosives would be stored and/ or used	Construction phase		To be implemented as per construction programme
A7A	6	The explosive truck accident frequency should be minimized by implementing a dedicated training programme for both the driver and his attendants, including regular briefing sessions, implementation of a defensive driving attitude. In addition, drivers should be selected based on good safety record, and medical checks.	To meet the ALARP requirement.	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	The contractor should as far as practicable combine the explosive deliveries for a given work area.	To meet the ALARP requirement.	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
A7A	6	The explosive truck fire involvement frequency should be minimized by implementing a better emergency response and training to make sure the adequate fire extinguishers are used and attempt is made to evacuate the area of the incident or securing the explosive load if possible. All explosive vehicles should also be equipped with bigger capacity AFFF-type extinguishers.	To meet the ALARP requirement.	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	A minimum headway between two consecutive trucks conveys of at least 10 min is recommended.	To ensure that the risk from the proposed explosives transport would not be unacceptable	MTRC/ Contractor	Along explosives transport route	Construction phase		To be implemented as per construction programme
A7A	6	Use only experienced driver(s) with good safety record for explosive vehicle(s). Training should be provided to ensure it covers all major safety subjects.	To ensure safe transport of explosives	MTRC/ Contractor	At suitable location	Construction phase		To be implemented as per construction programme
A7A	6	Develop procedure to ensure that parking space on the site is available for the explosive truck. Confirmation of parking space should be communicated to truck drivers before delivery.	To ensure that the risks from the proposed explosives storage and transport would not be unacceptable	MTRC/ Contractor	Explosive magazine	Construction phase		To be implemented as per construction programme
A7A	6	Delivery vehicles shall not be permitted to remain unattended within the magazine site (or appropriately wheel-locked).	To reduce the risk of fire within the magazine	MTRC / Contractor	Explosive Magazine	Construction phase		To be implemented as per construction programme
A7A	6	Good house-keeping within and outside of the magazine to ensure that combustible materials (including vegetation) are removed and not allowed to accumulate.	To reduce the risk of fire within the magazine	MTRC / Contractor	Explosive Magazine	Construction phase		To be implemented as per construction programme
A7A	6	Detonators shall not be transported in the same vehicle with other Class 1 explosives.	To reduce the risk of explosion during the transport of cartridge emulsion	MTRC / Contractor		Construction phase		To be implemented as per construction programme
A7A	6	Emergency plan (i.e. magazine operational manual) shall be developed to address uncontrolled fire in magazine area. The case of fire near an explosive carrying truck in jammed traffic should also be covered. Drill of the emergency plan should be carried out at regular intervals.	To reduce the risk of fire	MTRC/ Contractor	Explosive Magazine and along explosives transport route	Construction phase		To be implemented as per construction programme
A7A	6	Adverse weather working guideline should be developed to clearly define procedure for transport explosives during thunderstorm.	To ensure safe transport of explosives	MTRC/ Contractor	Along explosives transport route	Construction phase		To be implemented as per construction programme

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
A7A	6	During transport of the explosives within the tunnel, hot work should not be permitted.	To ensure safe transport of explosives	MTRC/ Contractor	Along explosives transport route	Construction phase		To be implemented as per construction programme
A7A	6	Ensure that UN 1.4B packaging of detonators remains intact until handed over at blasting site.	To reduce the risk of explosion during the transport of detonator	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	Contractor to ensure that any electro-explosive devices are sufficiently shielded from radio frequency radiation hazards.	To reduce the risk of explosion during the transport of detonators	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	Steel vehicle tray welded to a steel vertical fire screen should be mounted at least 150 mm behind the drivers cab and 100 mm from the steel cargo compartment, the vertical screen shall protrude 150 mm in excess of all three (3) sides of the steel cargo compartment.	To reduce the risk during explosives transport.	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	Ensure cartridge emulsion with high water content should be preferred. Also, the emulsion with perchlorate formulation should be avoided.	To ensure safe explosives to be used	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	Traffic Management should be implemented within the temporary magazine site, to ensure that no more than 1 vehicle will be loaded at any time, in order to avoid accidents involving multiple vehicles within the site boundary. Based on the construction programme, considering that 6 trucks could be loaded over a peak 2 hour period, this is considered feasible.	To ensure that the risks from the proposed explosives storage and transport would not be unacceptable	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	The design of the fill slope close to the temporary magazine site should consider potential washout failures and incorporate engineering measures to prevent a washout causing damage to the temporary magazine stores	To ensure that the risks from the proposed explosives storage would not be unacceptable	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	The security plan should address different alert security level to reduce opportunity for arson / deliberate initiation of explosives. The corresponding security procedure should be implemented with respect to prevailing security alert status announced by the Government.	To ensure that the risks from the proposed explosives storage would not be unacceptable	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme

Appendix F Implementation of Environmental Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
A7A	6	A suitable work control system should be introduced, such as an operational manual including Permit-to-Work system.	To ensure that the risks from the proposed explosives storage would not be unacceptable	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
A7A	6	The magazine building shall be regularly checked for water seepage through the roof, walls or floor.	To ensure that the risks from the proposed explosives storage would not be unacceptable	MTRC/ Contractor	-	Construction phase		To be implemented as per construction programme
<b>Waste Management (Construction Phase)</b>								
8.5.1.1	7	<p><b>Good Site Practices</b></p> <p>Recommendations for good site practices during the construction activities include:</p> <ul style="list-style-type: none"> <li>Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site</li> <li>Training of site personnel in proper waste management and chemical handling procedures</li> <li>Provision of sufficient waste disposal points and regular collection of waste</li> <li>Appropriate measures to minimise windblown litter and dust/odour during transportation of waste by either covering trucks or by transporting wastes in enclosed containers</li> <li>Provision of wheel washing facilities before the trucks leaving the works area so as to minimise dust introduction from public road</li> <li>Well planned delivery programme for offsite disposal such that adverse environmental impact from transporting the C&amp;D material is not anticipated</li> <li>Provision of cover for the stockpile material, sand bag or earth bund as barrier to prevent material from washing away and entering the drains</li> </ul>	To reduce waste generation	MTRC / Contractor	Construction Work Sites (General)	During Construction	<p>Waste Disposal Ordinance (Cap.354);</p> <p>Waste Disposal (Chemical Wastes) (General) Regulation (Cap 354) and</p> <p>ETWBTC No. 15/2003, Waste Management on Construction Site</p>	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
8.5.1.2	7	<p><b>Waste Reduction Measures</b> Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> <li>Sort C&amp;D material from demolition and decommissioning of the existing facilities to recover recyclable portions such as metals</li> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal</li> <li>Encourage collection of aluminium cans by providing separate labelled bins to enable this waste to be segregated from other general refuse generated by the work force</li> <li>Proper storage and site practices to minimise the potential for damage or contamination of construction materials</li> <li>Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste.</li> </ul>	For perform waste reduction	MTRC / Contractor	Construction Work Sites (General)	During Construction	<p>Waste Disposal Ordinance (Cap.354);</p> <p>Waste Disposal (Chemical Wastes) (General) Regulation; Land (Miscellaneous Provisions) Ordinance (Cap. 28)</p>	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
8.5.1.3	7	<p><b>C&amp;D Material</b></p> <p>In order to minimise impacts resulting from collection and transportation of C&amp;D material for off-site disposal, the excavated materials should be reused on-site as backfilling material as far as practicable. In addition, C&amp;D material generated from excavation works could be reused as rock material in local projects that require public fill for reclamation and earth filling purposes, say, 'Hong Kong – Zhuhai – Macao Bridge' in association with Hong Kong Boundary Crossing Facilities and Hong Kong Link Road, Central-Wanchai Bypass and Wanchai Development Phase II project (subject to further coordination). The surplus rock and other inert C&amp;D material should be disposed of at the Government's Public Fill Reception Facilities (PFRFs), for beneficial use by other projects in the HKSAR, or transported to Mainland China via CEDD for use by other suitable projects in the Mainland. C&amp;D waste generated from general site clearance and tree felling works would require disposal to the designated landfill site. Other mitigation requirements are listed below:</p> <ul style="list-style-type: none"> <li>• A Waste Management Plan should be prepared and</li> <li>• In order to monitor the disposal of C&amp;D material and solid wastes at public filling facilities and landfills, and to control fly-tipping, a trip-ticket system (e.g. ETWB TCW No. 31/2004) should be included.</li> </ul>	To minimize impacts resulting from collection and transportation of C&D material for off-site disposal	MTRC / Contractor	Construction Work Sites (General)	During Construction	ETWB TCW No. 31/2004	Being implemented
8.5.1.4	7	<p><b>General Refuse</b></p> <p>General refuse should be stored in enclosed bins or compaction units separate from C&amp;D material. A reputable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&amp;D material. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' light material.</p>	To minimize impacts resulting from collection and transportation of general refuse for off-site disposal	MTRC / Contractor	Construction Work Sites (General)	During Construction	Public Health and Municipal Services Ordinance (Cap. 132) - Public Cleansing and Prevention of Nuisances Regulation	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
8.5.1.5	7	<p><b>Chemical Waste</b></p> <p>If chemical wastes are produced at the construction site, the Contractor would be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the <i>Code of Practice on the Packaging Labelling and Storage of Chemical Wastes</i>. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. The Contractor should use a licensed collector to transport and dispose of the chemical wastes, to either the approved Chemical Waste Treatment Centre, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</p>	To minimize impacts resulting from collection and transportation of chemical waste for off-site disposal	MTRC / Contractor	Construction Work Sites (General)	During Construction	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes, Waste Disposal (Chemical Waste) (General) Regulation	Being implemented
8.5.1.6	7	<p><b>Marine Dredged Sediment</b></p> <p>The sediment at the pier site would be dredged and transferred to barges for subsequent disposal. Release of dredged sediment into the surrounding water should be avoided. It is recommended that the distance between the barge and the dredging point be shortened as far as possible to avoid dropping of sediment from the close grab to the seawater.</p>	To minimise potential impacts on water quality	MTRC/ Contractor	Dredging/ excavation area required for installation of the pier/pier structure in Aberdeen Channel	During marine construction works	ETWB TCW No. 34/2002	Implemented
8.5.1.6	7	<p>Category H material was identified at the grab sampling location at the dredging/excavation site. As there was no exceedance of 10xLCEL for the tested parameters, the sediment to be dredged at this location should be disposed of at a confined marine disposal site. The Project Proponent should agree with MFC on the allocation of disposal site and the Contractor should apply a dumping permit from EPD prior to the dredging / excavation works.</p>	To prevent cross contamination of waste.	MTRC/ Contractor	Dredging/ excavation area with Category H material	During marine construction works	ETWB TCW No. 34/2002	Implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<b>Waste Management (Operation Phase)</b>								
8.5.2.1	7	<p><b>General Refuse</b></p> <p>General refuse should be collected on daily basis and delivered to the refuse collection point accordingly. A reputable waste collector should be employed to remove general refuse regularly to avoid odour nuisance or pest and vermin problem. Recycling containers are recommended to be provided to encourage recycling aluminium cans and waste paper.</p>	To minimize impacts resulting from collection and transportation of general refuse for off-site disposal	MTRC	Stations and depot	During Operation	Public Health and Municipal Services Ordinance (Cap. 132) - Public Cleansing and Prevention of Nuisances Regulation	To be implemented as per construction programme
8.5.2.2	7	<p><b>Industrial Waste</b></p> <p>Similar to general refuse, a reputable waste collector should be employed to remove industrial waste regularly to avoid accumulation. Scrap materials such as metals can be recycled if uncontaminated.</p>	To minimize impacts resulting from collection and transportation of industrial waste for off-site disposal	MTRC	Stations and depot	During Operation	Public Health and Municipal Services Ordinance (Cap. 132) - Public Cleansing and Prevention of Nuisances Regulation	To be implemented as per construction programme
8.5.2.3	7	<p><b>Chemical Waste</b></p> <ul style="list-style-type: none"> <li>Register with the EPD as a chemical waste producer should be obtained and guidelines stated in the <i>Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes</i> should be followed.</li> <li>Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. Licensed collector should be deployed to transport and dispose of the chemical wastes, to either the approved Chemical Waste Treatment Centre, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</li> </ul>	To minimize impacts resulting from collection and transportation of chemical waste for off-site disposal	MTRC	Stations and depot	During Operation	Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	To be implemented as per construction programme
<b>Land Contamination (Construction Phase)</b>								

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
9.7.1	8	<p>The following measures should be implemented for contaminated material excavation and transportation (if any):</p> <ul style="list-style-type: none"> <li>• To minimize the chance for construction workers' to come into contact with contaminated materials, bulk earth-moving excavation equipment should be employed;</li> <li>• Contact with contaminated materials can be minimised by wearing appropriate clothing and personal protective equipment such as gloves and masks (especially when interacting directly with contaminated material), provision of washing facilities and prohibition of smoking and eating on site;</li> <li>• Stockpiling of contaminated excavated materials on site should be avoided as far as possible;</li> <li>• The use of contaminated soil for landscaping purpose should be avoided unless pre-treatment was carried out;</li> <li>• Vehicles containing any excavated materials should be suitably covered to reduce dust emissions and/or release of contaminated wastewater;</li> <li>• Truck bodies and tailgates should be sealed to stop any discharge;</li> <li>• Only licensed waste haulers should be used to collect and transport contaminated material to treatment/disposal site and with the implementation of tracking system to avoid fly tipping;</li> <li>• Speed control for trucks carrying contaminated materials should be carried out;</li> <li>• Observe all relevant regulations in relation to waste handling, such as Waste Disposal Ordinance (Cap 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap 354) and obtain all necessary permits where required; and</li> <li>• Maintain records of waste generation and disposal quantities and disposal arrangements.</li> </ul>	To minimize as much as possible any nuisance generated in relation to land remediation activities. At the same time, to protect all personnel from possible risk associated with land remediation activities.	MTRC / Contractor	All site areas	During Construction	EIA Recommendations	Being implemented

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<b>Land Contamination (Operation Phase)</b>								
9.7.2	8	Defined procedures in handling chemicals should be implemented as part of MTRCL company policy. All relevant operational procedures should be strictly followed to avoid land contamination.	To minimize as much as possible any risk in association with land contamination during operation of the Project	MTRC	All areas within the Project	During Operation	EIA Recommendations	To be implemented as per construction programme
<b>Air Quality Impact (Construction Phase)</b>								
10.6.2	9	<b>Specific Dust Control Measures</b>	To minimize adverse dust emission generated from various construction activities of the works sites	Contractor	Construction Works Sites	During Construction	EIA Recommendations	Being implemented
		<ul style="list-style-type: none"> <li>For the unloading of spoil from trucks at barging point, installation of 3-sided screen with top and the provision of water sprays at the discharge point should be provided</li> </ul>						
		<ul style="list-style-type: none"> <li>Watering every working hour for 12 hours a day on exposed soil areas on active works areas and paved haul roads to reduce dust emissions</li> </ul>						
		<ul style="list-style-type: none"> <li>The rock crushing facilities with maximum daily output of over 1000m<sup>3</sup> per day should be enclosed including unloading locations and a fabric baghouse/cartridge filter type dust extraction and collection system or equivalent system with 99% or more dust removal efficiency should be installed for the treatment of the emissions from rock crushing and screening processes.</li> </ul>						
10.6.2	9	Best practices for dust control are required. A control programme can be instigated to monitor the construction process in order to enforce dust controls and modify methods of works where feasible to reduce the dust emission down to acceptable levels. The following best practices for dust control should be implemented throughout the construction period: <b>Disturbed Parts of the Roads</b>	To minimize adverse dust emission generated from various construction activities of the works sites	Contractor	Construction Works Sites	During Construction	Air Pollution Control (Construction Dust) Regulation, EPD's Best Practicable Means and EIA Recommendations	
		<ul style="list-style-type: none"> <li>Each and every main temporary access should be paved with concrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or</li> </ul>						

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
		<ul style="list-style-type: none"> <li>• Unpaved parts of the road would be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.</li> </ul> <p><b>Exposed Earth</b></p> <ul style="list-style-type: none"> <li>• Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seeding with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.</li> </ul> <p><b>Loading, Unloading or Transfer of Dusty Materials</b></p> <ul style="list-style-type: none"> <li>• All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.</li> </ul> <p><b>Debris Handling</b></p> <ul style="list-style-type: none"> <li>• Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides.</li> <li>• Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.</li> <li>▪ For the minor blasting at WCH Depot, tarpaulin covers would be provided on the steel screens to prevent the dust from spreading out, and the whole blasting area would be watered before and after each blast in order to help contain the dust and fumes.</li> </ul> <p><b>Transport of Dusty Materials</b></p> <ul style="list-style-type: none"> <li>• Vehicle used for transporting dusty materials/ spoil should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.</li> </ul> <p><b>Wheel Washing</b></p> <ul style="list-style-type: none"> <li>• Vehicle wheel washing facilities should be provided at each construction site exit.</li> </ul>						

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
		<p><b>Stone Crushing Plant</b></p> <ul style="list-style-type: none"> <li>The control measures listed in EPD's A Guidance Note on the Best Practicable Means for Mineral Works (Stone Crushing Plants) BPM 11/1) should be followed, where appropriate.</li> </ul> <p><b>Concrete Batching Plant</b></p> <ul style="list-style-type: none"> <li>The loading, unloading, handling, transfer or storage of dusty materials should be carried in a totally enclosed system. All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system. The control measures listed in EPD's A guidance note on the best practicable means for cement works (concrete batching plant) (BPM 3/2) should be followed, where appropriate.</li> </ul> <p><b>Good Site Management</b></p> <ul style="list-style-type: none"> <li>The Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust emission. Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimize the release of visible dust emission. Any piles of materials accumulated on or around the work areas should be cleaned up regularly. Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimizing generation of fugitive dust emissions. The material should be handled properly to prevent fugitive dust emission before cleaning.</li> </ul>						

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status
<b>Cultural Heritage Impact (Construction Phase)</b>								
11.7.1.1	10	Archaeological watching brief during the construction phase is recommended for areas highlighted as having some archaeological potential (The works sites that will require archaeological watching brief can be found in the following figures in the main report: Harcourt Garden (Figure 11.22 of EIA Report), Wong Chuk Hang San Wai (WS10) in Figure 11.35 of EIA Report and Works Sites S7, S7c, S7d and S7e (Figure 11.28 of EIA Report)	To identify and record any archaeological material or features revealed during the excavation phase of the works schedule	MTRC/ Contractor	Admiralty: Harcourt Garden Works Site; Wong Chuk Hang: Works Sites S7c,d,e, Works Site S7, Pier Columns within Works Site S10	During Construction	Antiquities and Monuments Ordinance	Implemented