



PENTA-OCEAN CONSTRUCTION COMPANY LIMITED

REMAINING ENGINEERING
INFRASTRUCTURE WORKS FOR PAK
SHEK KOK DEVELOPMENT PACKAGE 1
(CONTRACT NO.: TP 35/02)

MONTHLY EM&A REPORT

(OCTOBER 2004)

Prepared by: Linda Law
Linda Law
Environmental Officer

Checked by: C. L. Lau
C. L. Lau
Environmental Team Leader

Approved by: Tony Wong
Tony Wong
Operations Manager

Reporting period: 01 to 31 October 2004

Report No.: ENA 40481



TABLE OF CONTENTS		Page
EXECUTIVE SUMMARY		
1.0	INTRODUCTION	1
2.0	PROJECT INFORMATION	
	2.1 Background	1
	2.2 Site Description	1
	2.3 Construction Programme	1
	2.4 Project Organization and Management Structure	1
	2.5 Contact Details of Key Personnel	1-2
3.0	CONSTRUCTION PROGRESS IN THIS REPORTING MONTH	2
4.0	AIR QUALITY MONITORING	
	4.1 Monitoring Requirement	3
	4.2 Monitoring Equipment	3
	4.3 Monitoring Parameters, Frequency and duration	3
	4.4 Monitoring Locations and Period	3-4
	4.5 Monitoring Methodology	4-5
	4.6 Action and Limit levels	5-6
	4.7 Event-Action Plans	6
	4.8 Results	6
5.0	NOISE MONITORING	
	5.1 Monitoring Requirement	6
	5.2 Monitoring Equipment	6-7
	5.3 Monitoring Parameters, Frequency and duration	7
	5.4 Monitoring Locations and Period	7-8
	5.5 Monitoring Methodology	8
	5.6 Action and Limit levels	8
	5.7 Event-Action Plans	8
	5.8 Results	9
6.0	WASTEWATER MONITORING	9
7.0	ENVIRONMENTAL NON-CONFORMANCE	
	7.1 Summary of air quality, noise and wastewater monitoring	9-10
	7.2 Summary of environmental complaints	10
	7.3 Summary of notification of summons and prosecutions	10
8.0	SITE INSPECTION	
	8.1 Summary of site inspection findings and Action(s) taken by POC and ET	10
	8.2 Status of Environmental Licensing and Permitting	11
	8.3 Recommendation on Site Inspection findings	11
9.0	WASTE MANAGEMENT	
	9.1 Waste Management Audit	11
	9.2 Records of waste quantities	12
10.0	Implementation Status	
	10.1 Implementation Status of Environmental Mitigation Measures	12
	10.2 Implementation Status of Event and Action Plan	12
	10.3 Implementation Status of Environmental Complaint Handling	12
11.0	CONCLUSION	13
12.0	FUTURE KEY ISSUE	
	12.1 Upcoming EM&A Schedule in coming two months	13
	12.2 Upcoming Construction Works Schedule in coming month	13



APPENDIX

- A Organization Chart and Lines of Communication
- B1 Calibration Certificates for Impact Air Quality Monitoring Equipment
- B2 Impact Air Quality Monitoring Results
- B3 Graphical Plots of Impact Air Quality Monitoring Data
- C1 Calibration Certificates for Impact Noise Monitoring Equipment
- C2 Impact Noise Monitoring Results
- C3 Graphical Plots of Impact Noise Monitoring Data
- D Weather Condition
- E Event-Action Plans
- F Construction Programme
- G Construction Site Area
- H Summary of the Implementation Status of the Mitigation Measures
- I IEC and RE Comments on Monthly EM&A Report – September 2004
- J Wastewater Monitoring – Testing Report of Wastewater Samples from Discharge Points

Figure

- Figure 1 Location of Noise Monitoring Locations
- Figure 2 Location of Air Monitoring Locations
- Figure 3 Location of Air and Noise Monitoring Stations at HKIB Staff Accommodation
- Figure 4 Location of Noise Monitoring Station at CUHK Residence No. 10
- Figure 5 Location of Air and Noise Monitoring Stations at Cheung Shue Tan Village

Tables

- 2.1 Contact Details of Key Personnel
- 3.1 Major Construction Activities in this reporting month
- 3.2 Implementation of Environmental Mitigation Measures
- 4.1 Air Quality Monitoring Equipment
- 4.2 Monitoring parameters, duration and frequency of air quality monitoring
- 4.3 Air Quality Monitoring Locations
- 4.4 Monitoring Schedule for air quality monitoring stations
- 4.5 Action and Limit levels for 24-hr TSP and 1-hr TSP
- 5.1 Noise Monitoring Equipment
- 5.2 Duration, Frequency and Parameters of noise monitoring
- 5.3 Noise Monitoring Locations
- 5.4 Monitoring Schedule for noise monitoring stations
- 5.5 Action and Limit levels for noise monitoring
- 7.1 A Cumulative Log of Notification of Summons and Prosecution
- 8.1 The summary of the IEC and ET site inspection findings and Action(s) taken by POC and ET
- 8.2 Summary of environmental licensing and permit status
- 9.1 Summary of Quantities of waste for disposal
- 12.1 Upcoming EM&A Schedule in coming two months
- 12.2 Upcoming Construction Works Schedule in coming month



EXECUTIVE SUMMARY

This monthly EM&A report (No.22) has been prepared to document the impact monitoring works conducted for the Contract of the Remaining Engineering Infrastructure Works for Pak Shek Kok Development Package 1 (Contract No: TP 35/02) during the reporting period from 01 to 31 October 2004.

Construction Progress

The major construction works in this reporting month were as below:

- Drainage works in Zone P and Area 15
- Watermain installation work
- Roadworks for Zone P and Area 15
- Drainage and Watermain Works under KCRC bridge
- Construction of pumping station no.1 and no.2
- Construction of Road D1 Bridge
- Rectification of jogging track and cross-link fence in HKIED

Environmental Monitoring Progress

The summary of the monitoring activities in this monitoring month is listed below:

- Noise Monitoring (Day-time): 4 Occasions at 3 designated locations
- Noise Monitoring (Evening-time): 4 Occasions at 3 designated locations
- Noise Monitoring (Holiday): 5 Occasions at 3 designated locations
- 24-hour TSP Monitoring: 5 Occasions at 2 designated locations
- 1-hour TSP Monitoring: 13 Occasions at 2 designated locations
- Weekly-site inspection: 5 Occasions

Noise Monitoring

No exceedances of Action and Limit levels for noise monitoring were recorded in the reporting month.

Air Monitoring

No exceedances of Action and Limit levels were recorded for 24-hr TSP and 1-hr TSP monitoring in the reporting month.

Site Inspection

Environmental site inspections conducted in this reporting month are presented as follows:

<u>Concerned Parties</u>	<u>Dates of Audit / Inspection</u>
ET (weekly site inspection)	02, 09, 16, 23, 30
IEC/POC/ET (Monthly site inspection)	21

Two observations were raised during this reporting month. The site inspection findings are presented as follows:

Item	Aspects	Findings	Action(s) taken by POC	ET Verification
1	Air (Obs.)	Some of the stockpiles were not entirely covered during weekly site inspection. They should be backfilled, entirely covered with impervious tarpaulin sheets or hydroseeded.	POC replied that the stockpile will be covered with tarpaulin sheets or sprayed with water.	During the last weekly site inspection in this reporting month, most of the stockpile were covered with tarpaulin sheets or sprayed with water.
2	Air (Obs)	Some part of haul road and surface areas were observed during weekly and monthly joint site inspections.	These areas were covered and watering was provided more frequently.	During the last site inspection in this reporting month, the dusty ground was found watered and no fugitive dust was observed.

Remark: "NC" = Non-compliance and "Obs" = Observation



Environmental Complaints

No environmental complaints were received in this monitoring month.

Notification of summons and successful prosecutions

No notification of summons and prosecutions with respect to environmental issues were registered in this reporting month.

Future Key Issues

Base on the site inspections and forecast of engineering works in the coming month, key issues to be considered are as follows:

- Noise and air quality impact due to construction works;
- Maintain wheel washing facilities properly;
- Cleanup the access road regularly;
- Watering, hydro-seeding or covering all stockpiles with tarpaulin to avoid wind and water erosion;
- Diverting the silty runoff to sedimentation trap before discharge;
- Maintain good site practice and waste management to minimize environmental impacts at the site;
- Follow-up improvements on waste management issues.



1.0 INTRODUCTION

Penta-Ocean Construction Co., Ltd. (POC) appointed Environmental Team (ET) of ETS-Testconsult Limited (ETL) to undertake the Environmental Monitoring and Audit for Remaining Engineering Infrastructure Works for Pak Shek Kok Development Package 1 (Contract No.: TP 35/02).

Under the requirements of Section 10 of Environmental Permit to Construct and Operate a Designate Project (EP-108/2001/AEP-108/2001), EM&A programme as set out in the EM&A Manual is required to be implemented. In accordance with the EM&A manual, environmental monitoring of air quality and noise is required for the Project. The EM&A requirement for each parameter are described in details in subsequent sections, including:

- All monitoring parameters;
- Action and Limit levels for all environmental parameters;
- Event-Action Plans;
- Environmental mitigation measures, as recommended in the project EIA study report;
- Environmental requirements in contract documents.

This monthly EM&A report summarizes the impact monitoring results and audit findings of the EM&A program during the reporting period from 01 to 31 October 2004.

2.0 PROJECT INFORMATION

2.1 Background

Remaining Engineering Infrastructure Works for Pak Shek Kok Development Package 1 (Contract No.: TP 35/02) was planned and designed by the Civil Engineering and Development Department (CEDD).

As the main Contractor of the captioned project: contracted by, POC will follow the environmental monitoring recommendation stated at the EM&A Manual that was prepared with reference to the EIA Study for Feasibility Study on the Pak Shek Kok Development Area (PSKDA) Environmental Monitoring and Audit Manual under Agreement No. CE 90/96.

2.2 Site Description

Generally, the construction site is located at Pak Shek Kok development area. Surrounding the construction site, there are two air sensitive receivers: HKIB Staff Accommodation and Cheung Shue Tan Village and three noise sensitive receivers: HKIB Staff Accommodation, CUHK Residence No.10 and Cheung Shue Tan Village.

Figure 1 and 2 show the noise and air monitoring locations of this project.

2.3 Construction Programme

Details of construction programme (from September to November 2004) are shown in Appendix F.

2.4 Project Organization and Management Structure

The organization chart and lines of communication with respect to the on-site environmental management and monitoring program are shown in Appendix A.

2.5 Contact Details of Key Personnel

The key personnel contact names and telephone numbers, and construction programme are shown in table 2.1.



Table 2.1 Contact Details of Key Personnel

Organization	Project Role	Name of Key Staff	Tel. No.	Fax No.
CEDD	Employer	Mr. H W Lau	2158 5629	---
Hyder	Engineer	Mr. Herman Fong	2911 2233	2827 2891
Hyder	Independent Environmental Checker	Ir. Coleman Ng	2911 2233	2827 2891
POC	Contractor	Mr. Roger Lau	9870 6390	2691 6012
ETL	Contractor's Environmental Team	Mr C L Lau (Environmental Team Leader)	2946 7792	2695 3944

3.0 CONSTRUCTION PROGRESS IN THIS REPORTING MONTH

The site area of this project is shown in Appendix G.

A summary of the major construction activities undertaken in this monitoring month is shown in Table 3.1. The implementation of corresponding mitigation measures is summarized in Table 3.2.

Table 3.1 Major Construction Activities in this reporting month

Location	Major Construction Activity
Zone P and Area 15	Drainage work
Zone P and Area 15	Roadworks
KCRC Bridge	Drainage and Watermain Works
Road D1	Construction of Road Works
No.1 & No.2	Construction of pump stations
HKIED	Rectification of jogging track and cross-link fence
---	Watermain installation work

Table 3.2 Implementation of Environmental Mitigation Measures

General construction works	<ul style="list-style-type: none"> • Effective water sprays used on the site at potential dust emission sources such as unpaved area; • The heights from which fill materials are dropped should be controlled to a practical height to minimize the fugitive dust arising from unloading; • Minimize of exposed soil areas to reduce the potential for increased siltation and contamination of run-off; • Water, hydro-seed or cover the open stockpile and exposed loose soil areas by using clean tarpaulin sheets; • Provide proper and efficient drainage facilities (e.g. wheel washing facilities) and sedimentation system to ensure that site runoff should be treated before discharged to drains; • Remove the sand/rubbish accumulated in the drain/channel regularly; • Provide good site practice (e.g. selection of quieter plant and working methods and reduction in number of plant operating in critical areas close to NSRs) to limit noise emissions at source; • Remove the construction waste accumulated inside or outside the site regularly; • Keep good waste management.
----------------------------	--



4.0 AIR QUALITY MONITORING

4.1 Monitoring Requirement

1-hour and 24-hour TSP monitoring were required to be conducted to monitor the air quality, at designated monitoring locations:

- HKIB Staff Accommodation (on ground floor near the entrance facing south-east);
- Cheung Shue Tan Village (near the outer building, temple) for 1-hr TSP monitoring;
- Cheung Shue Tan Village (in front of Man Kee Store) for 24-hr TSP monitoring.

4.2 Monitoring Equipment

Continuous 24-hour TSP air quality monitoring was performed using a GMWS2310 High Volume Air Sampler (HVS) located at each of the designated monitoring station. One portable dust meter was used to carry out the 1-hour TSP monitoring. Table 4.1 summarizes the equipment used in the air quality monitoring programme. A copy of the calibration certificate for the HVS and portable dust meter are attached in Appendix B1.

Table 4.1 Air Quality Monitoring Equipment

Equipment	Model and Make
HVS Sampler	Greasby GMWS2310
Calibrator	G25 A
1-hour TSP Dust Meter	TSI Model 8520 Dust Trak™ Aerosol Monitor

4.3 Monitoring Parameters, Frequency and Duration

Table 4.2 summarizes the monitoring parameters, monitoring duration and frequencies of air quality monitoring.

Table 4.2 Monitoring parameters, duration, frequencies of impact air quality monitoring

Parameter	Duration	Frequency
24-hr TSP	24 hr (0000-2400)	Once every six days
1-hr TSP	1 hr (0700-1900)	Three times every six days

4.4 Monitoring Locations and Schedule

Two designated air quality monitoring locations – Cheung Shue Tan Village and HKIB Staff Accommodation were selected. Table 4.3 tabulates the air quality monitoring locations of this project.

Table 4.3 Air quality monitoring locations

Air quality Monitoring stations	Locations
AM1	HKIB Staff Accommodation (on ground floor near the entrance facing south-east) for 1-hr TSP monitoring
AM3	Cheung Shue Tan Village (near the outer building, temple) for 1-hr TSP monitoring
AM3A	Cheung Shue Tan (in front of Man Kee Store) for 24-hr TSP monitoring

The air quality monitoring schedule for 24-hr and 1-hr TSP monitoring at designated monitoring locations is summarized in table 4.4.



Table 4.4 Monitoring Schedule for the air quality monitoring stations

Air quality monitoring stations	Location	Monitoring Period						
		24-hr TSP				1-hr TSP		
		Start		Finish		Date	Start	Finish
		Date	Time	Date	Time			
AM1	HKIB Staff Accommodation					02/10/04	14:08	15:08
						05/10/04	08:50	09:50
						07/10/04	08:20	09:20
						09/10/04	08:20	09:20
						12/10/04	08:38	09:38
						14/10/04	09:10	10:10
						16/10/04	14:48	15:48
						19/10/04	08:35	09:35
						21/10/04	09:30	10:30
						23/10/04	13:00	14:00
						26/10/04	08:20	09:20
						28/10/04	08:50	09:50
						30/10/04	13:30	14:30
AM3	Cheung Shue Tan Village (near the outer building, temple)					02/10/04	16:22	17:22
						05/10/04	10:45	11:45
						07/10/04	14:32	15:32
						09/10/04	11:14	12:14
						12/10/04	13:05	14:05
						14/10/04	14:42	15:42
						16/10/04	17:02	18:02
						19/10/04	14:08	15:08
						21/10/04	11:00	12:00
						23/10/04	15:18	16:18
						26/10/04	13:20	14:20
				28/10/04	14:05	15:05		
				30/10/04	15:45	16:45		
AM1	HKIB Staff Accommodation	04/10/04	09:12	05/10/04	09:22			
		09/10/04	08:25	10/10/04	08:29			
		15/10/04	11:20	16/10/04	11:28			
		20/10/04	08:56	21/10/04	08:45			
		26/10/04	10:10	27/10/04	10:08			
AM3A	Cheung Shue Tan (in front of Man Kee Store)	04/10/04	09:30	05/10/04	09:47			
		09/10/04	11:18	10/10/04	11:45			
		15/10/04	11:38	16/10/04	12:04			
		20/10/04	09:16	21/10/04	09:43			
		26/10/04	11:32	27/10/04	11:00			

4.5 Monitoring Methodology

4.5.1 24-hour TSP Monitoring

Instrumentation

High volume sampler, as HVS, (Greasby GMWS2310) complete with appropriate sampling inlets are employed for 24-hour TSP. The sampler is composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

Installation

The installation of HVS refers to the requirement stated in EM&A Manual.

Operation/Analytical Procedures

Operating/analytical procedures for the operation of HVS are as below:

Prior to the commencement of the dust sampling, the flow rate of the high volume sampler was properly set (between 0.6m³/min and 1.7m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard Title 40, CFR Part 50.



- For TSP sampling, fiberglass filters (GA-55) were used.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated 5 minutes to establish thermal equilibrium before placing any filter media at designated air monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an air-tight seal on the outer edges of the filter. Then the filter holder frame was tightened to the filter holder with swing bolts. The applied pressure should be sufficient to avoid air leakage at the edges.
- The programmable timer will be set for a sampling period of 24 hours. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number.).
- After sampling, the filter was transferred from the filter holder of the HVS to a sealed plastic bag and sent to the laboratory for weighting. The elapsed time was also recorded.
- Before weighting, all filters were equilibrated in a desiccator for 24 hour with the temperature of $25^{\circ}\text{C} \pm 3^{\circ}\text{C}$ and the relative humidity (RH) $<50\% \pm 5\%$.

Maintenance & Calibration

- The HVS and their accessories should be maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVS should be calibrated at bi-monthly intervals.

4.5.2 1-hour TSP Monitoring

Measuring Procedures

The measuring procedures of the 1-hr dust meter are in accordance with the Manufacturer's instruction Manual as follows:

- Set POWER to ON, check the battery indicator to ensure whether the power supply is enough to conduct the TSP monitoring;
- Calibrate the dust meter by zero check;
- Set the TIME CONSTANT of the dust meter;
- Press SAMPLE to start the TSP monitoring;
- Record the maximum, minimum and average reading directly from the dust meter by press STATISTICS when monitoring complete.

Maintenance & Calibration

- 1-hr dust meter should be checked at 3-month intervals and calibrated at 1-year intervals throughout all stages of impact air quality monitoring.

4.5.3 Wind Data Monitoring

Wind data (wind speed and wind direction) were directly extracted from Sha Tin Station (located at Sha Tin Race Course) of Hong Kong Observatory. All wind data during this reporting month are shown in Appendix D.

4.6 Action and Limit Levels

Action and Limit levels for 24-hr TSP and 1-hr TSP derived as illustrated in Table 4.5.



Table 4.5 Action and Limit Levels for 24-hr TSP and 1-hr TSP

Monitoring Location	24-hr TSP ($\mu\text{g}/\text{m}^3$)		1-hr TSP ($\mu\text{g}/\text{m}^3$)	
	Action Level	Limit Level	Action Level	Limit Level
AM1	164 *	260 *	325 *	500 *
AM3	---	---	306	500
AM3A	183	260	---	---

* = Reference to the information contained in the Baseline Monitoring Report submitted under the "Advance Engineering Infrastructure Works for Pak Shek Kok Development – Southern Access Road and Sewage Pumping Station No.3

4.7 Event-Action Plans

Please refer to Appendix E for details.

4.8 Results

4.8.1 24-hour TSP Monitoring

All monitoring data of 24-hour TSP monitoring is provided in Appendix B2. Graphical presentation of 24-hour TSP monitoring results for the reporting month is shown in Appendix B3.

No exceedances of Action and Limit Level of 24-hour TSP monitoring results were recorded during the reporting month.

4.8.2 1-hour TSP Monitoring

1-hour TSP monitoring was carried out at monitoring stations, AM1 and AM3 in the reporting month. All monitoring data of 1-hour TSP monitoring is provided in Appendix B2. Graphical presentation of 1-hour TSP monitoring results for the reporting month is shown in Appendix B3.

No exceedances of Action and Limit Level of 1-hour TSP monitoring results were recorded during the reporting month.

5.0 Noise Monitoring

5.1 Monitoring Requirements

As the requirement in EM&A Manual, noise monitoring was conducted at designated monitoring locations:

- HKIB Staff Accommodation (on ground floor near the entrance facing south-east);
- Cheung Shue Tan Village (near the outer building, temple);
- CUHK Residence No.10.

5.2 Monitoring Equipment

Integrating Sound Level Meters were used for noise monitoring. They were Type 1 sound level meters capable of giving a continuous readout of the noise level reading including equivalent continuous sound pressure level (L_{eq}) and percentile sound pressure level (L_x). They comply with International Electro technical Commission Publications 651:1979 (Type1) and 804:1985 (Type1), and speed in m/s was used to monitor the wind speed.

Table 5.1 summarized noise monitoring equipment model being used. A copy of the calibration certificates for noise meters and calibrator are attached in Appendix C1.



Table 5.1 Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-14 Sound Level Meter
Calibrator	Quest QC-20 Acoustic Calibrator
Portable Wind Speed Indicator	TSI Model 8340-M Air Velocity Meter

5.3 Monitoring Parameters, duration and Frequency

Noise monitoring for the A-weighted levels L_{eq} , L_{10} and L_{90} were recorded. The following guide on the regular monitoring frequency for each monitoring station on a per week basis when noise generating activities are underway:

- One set of measurements between 0700-1900 hours on normal weekdays (6 consecutive $L_{eq(5-min)}$);
- One set of measurements between 1900-2300 hours (3 consecutive $L_{eq(5-min)}$)*;
- One set of measurements between 2300-0700 hours of next day (3 consecutive $L_{eq(5-min)}$)*;
- One set of measurements between 0700-1900 hours on holidays (3 consecutive $L_{eq(5-min)}$)*.

(*): Noise monitoring to be conducted only when there is construction work.

Duration, frequencies and parameters of noise measurement are presented in Table 5.2.

Table 5.2 Duration, Frequencies and Parameters of Noise Monitoring

Time period	Duration/min	Parameters	Frequency
Day-time: 0700-1900 hrs on normal weekday	30	L_{eq} , L_{10} , L_{90}	Once per week
Evening-time: 1900-2300 hrs	15	L_{eq} , L_{10} , L_{90}	Once per week
Night-time: 2300-0700 hrs of next day	15	L_{eq} , L_{10} , L_{90}	Once per week
Holiday: 0700-1900 hrs	15	L_{eq} , L_{10} , L_{90}	Once per week

5.4 Monitoring Locations and Period

In accordance with the EM&A Manual, there are three noise monitoring locations: HKIB Staff Accommodation, Cheung Shue Tan Village and CUHK Residence No.10. The location of the monitoring stations are described in Table 5.3 and depicted in Figure 1.

Table 5.3 Noise Monitoring Locations

Noise Monitoring station	Location
NM1	HKIB Staff Accommodation (on ground floor near the entrance facing south-east)
NM2	CUHK Residence No.10
NM3	Cheung Shue Tan Village (near the outer building, a temple)

The noise-monitoring programme of monitoring locations (Day-time, Evening-time, Holiday and Night-time) is summarized in Table 5.4.

Table 5.4 Monitoring Periods for noise monitoring stations

Noise monitoring stations	Monitoring Period							
	Day-time		Evening-time		Holiday		Night-time	
NM1	05/10/04	10:00	05/10/04	19:00	03/10/04	09:10	---	---
	12/10/04	10:52	12/10/04	19:49	10/10/04	13:00	---	---
	19/10/04	10:50	19/10/04	19:00	17/10/04	09:45	---	---
	26/10/04	10:50	26/10/04	19:45	24/10/04	09:18	---	---
	---	---	---	---	31/10/04	14:00	---	---
NM2	05/10/04	10:00	05/10/04	19:25	03/10/04	09:38	---	---
	12/10/04	10:52	12/10/04	20:24	10/10/04	13:38	---	---
	19/10/04	10:50	19/10/04	19:28	17/10/04	10:10	---	---
	26/10/04	10:50	26/10/04	20:10	24/10/04	09:50	---	---
	---	---	---	---	31/10/04	14:35	---	---



Noise monitoring stations	Monitoring Period							
	Day-time		Evening-time		Holiday		Night-time	
NM3	05/10/04	10:50	05/10/04	19:50	03/10/04	10:12	---	---
	12/10/04	13:08	12/10/04	21:00	10/10/04	14:15	---	---
	19/10/04	15:14	19/10/04	19:58	17/10/04	10:35	---	---
	26/10/04	14:25	26/10/04	20:35	24/10/04	10:20	---	---
	---	---	---	---	31/10/04	15:15	---	---

5.5 Monitoring Procedures and Calibration Details

Operation/Analysis Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2m above the ground.
- For free field measurement, the meter was positioned away from any nearby reflective surfaces.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - Frequency weighting: A
 - Time weighting : Fast
 - Time measurement : 5 mins
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000HZ. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Free Field correction to the measurements should be made. Correction factor of +3dB(A) should be made to the free Field measurements.
- Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind gusts exceeding 10m/s.

Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The meter is sent to be supplier or HOKLAS laboratory to check and calibrated at yearly intervals.

5.6 Action and Limit Levels

The Action and Limit levels for noise levels derived as illustrated in Table 5.5.

Table 5.5 Action and Limit Levels for noise monitoring

Time Period	Time Period	Action	Limit
Normal hours	0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A) *
Holiday	0700-1900 hrs on holidays		70 dB(A) **
Evening-time	1900-2300 hrs on all other days		55 dB(A) **
Night-time	2300-0700 hrs of next day		

* = Reduce to 70 dB(A) for schools and 65 dB(A) during school examination periods.

** = Area Sensitivity Rating (ASR) C is selected from the "Technical Memorandum on Noise from Construction Work Other Than Percussive Piling".

5.7 Event-Action Plans

Please refer to the Appendix E for details.



5.8 Results

Day-time, Evening-time and Holiday noise monitoring were carried out at monitoring stations, NM1, NM2 and NM3 in this reporting month. No night-time noise monitoring were required since no construction works were processed during the night-time period. All noise levels are provided in Appendix C2. Graphical presentation of the monitoring results for the reporting month are shown in Appendix C3.

No day-time, evening-time and holiday noise monitoring results at all monitoring stations exceeded the Action Level since no documented complaints on noise issue were received in this reporting month. Besides, no exceedances in Limit Level were recorded according to the results from day-time, evening-time and holiday noise monitoring.

During the restricted hours, ET found that the PMEs used complied with the requirements stated in the valid CNP and no PMEs other than ones specified in the CNP to be used in the construction site.

6.0 WASTEWATER MONITORING

- 6.1 According to the Discharge of Industrial Trade Effluent Licence (Licence No.: 2946), POC is required to carry out wastewater monitoring of suspended solids quarterly at all effluent discharge points within the site.
- 6.2 POC appointed ET of ETL to sampling the wastewater samples at the effluent discharge points. The collected sample will be transport to the Environmental Laboratory of ETL for suspended solids content analysis. The Environmental Laboratory of ETL is HOKLAS accredited and the test method used for suspended solids analysis is also HOKLAS accredited in accordance with the 2540D of Standard Methods for the Examination of Water and Wastewater (APHA 19th edition).
- 6.3 Under the Discharge of Industrial Trade Effluent Licence (Licence No.: 2946), the discharge limit of Suspended Solids content of the effluent at this site should be 30mg/L. It means that the suspended solids of wastewater discharged should be less than 30mg/L or otherwise no wastewater can be discharged under this Licence.
- 6.4 Wastewater monitoring was carried out by ET at 09 September 2004 at discharge point PS1. During this monitoring, one wastewater sample was collected from the effluent discharge point and transport to ETL immediately for analysis. The result of suspended solids content of the wastewater sample was found below 30mg/L and within the discharge limit of the Discharge Licence. The test report for this monitoring was attached in Appendix J.
- 6.5 Since the effluent discharge licence required to carry out wastewater monitoring of suspended solids quarterly at all effluent discharge points within the site, the next wastewater monitoring should be at December 2004.

7.0 ENVIRONMENTAL NON-CONFORMANCE

7.1 Summary of air quality, noise and wastewater monitoring

No exceedances of Action and Limit Level of 24-hour and 1-hour TSP monitoring results were recorded during the reporting month.

No day-time, evening-time and holiday noise levels recorded at all monitoring stations exceeded the Action and Limit Level in the reporting month.



The suspended solids results of wastewater samples from discharge points were found within the discharge limit during monitoring period.

7.2 Summary of Environmental Complaints

No environmental complaints were received in this monitoring month.

7.3 Summary of Notification of Summons and Prosecution

There were no notification of summons respect to environmental issues registered in this month. Cumulative log of Notification of Summons and Prosecution is tabulated in Table 7.1.

Table 7.1 Cumulative Log of Notification of Summons and Prosecution

Date	Detail of Notice of Summons or Prosecution	Action Taken	Environmental Outcome
16 Oct 2002	The site main haul road was neither paved with any one of concrete, bituminous materials, hard core or metal plates, nor had the entire road surface maintained wet by the spraying of water or dust suppression chemical.	<ul style="list-style-type: none"> POC paved the site main haul road with concrete and bituminous materials; The road surface was wet by the spraying of water regularly by POC. 	It was observed that the problem of dust emission from the site main haul road has been improved. No further complaint or ticket was received during the reporting month.
11 July 2003	Three stockpiles of dusty material namely aggregate, were wither covered entirely by impervious sheeting, nor place in an area sheltered on top and three sites, nor sprayed with water or dust suppression chemical so as to maintain entire surface wet.	The stockpiles of aggregates / excavated materials were covered with tarpaulin sheet / sprayed with water in order to avoid the dust emission.	No further complaints were received during the reporting month.

8.0 SITE INSPECTION

Weekly site inspections were carried out by the ET. Five site inspections were undertaken in this reporting month (02, 09, 16, 23 and 30 October 2004). Monthly joint site inspection at 21 October 2004 was carried out by Engineer's Representative, IEC, POC and ET. A summary of the implementation status of the mitigation measures on site inspections is presented in Appendix H.

8.1 Summary of the site inspection findings and Action(s) taken by POC and ET

Summaries of the site inspection findings in this reporting month are shown in Table 8.1.

Table 8.1 The summary of the site inspection findings and Action(s) taken by POC and ET

Item	Aspects	Findings	Action(s) taken by POC	ET Verification
1	Air (Obs.)	Some of the stockpiles were not entirely covered during weekly site inspection. They should be backfilled, entirely covered with impervious tarpaulin sheets or hydroseeded.	POC replied that the stockpile will be covered with tarpaulin sheets or sprayed with water.	During the last weekly site inspection in this reporting month, most of the stockpile were covered with tarpaulin sheets or sprayed with water.
2	Air (Obs)	Some part of haul road and surface areas were observed during weekly and monthly joint site inspections.	These areas were covered and watering was provided more frequently.	During the last site inspection in this reporting month, the dusty ground was found watered and no fugitive dust was observed.



8.2 Status of Environmental Licensing and Permitting

All permits/licenses valid in October 2004 are summarized in Table 8.2.

Table 8.2 Summary of environmental licensing and permit status

Description	Permit No.	Valid Period		Section
		From	To	
Environmental Permit	EP-108/2001	05/11/02	---	Whole work site
Construction Noise Permit (General / Prescribed construction works)	GW-RN0440-04	15/09/04	10/02/05	<p><u>Group A (For Area B2 or E)</u></p> <ul style="list-style-type: none"> • 1 Poker, vibratory, hand-held (CNP 170) • 1 Concrete pump, lorry mounted (CNP 047) • 2 Concrete lorry mixer (CNP 044) <p><u>Group B (For Area B2 or E)</u></p> <ul style="list-style-type: none"> • 1 Poker, vibratory, hand-held (CNP 170) • 2 Concrete lorry mixer (CNP 044) • 1 Crane, mobile (diesel) (CNP 048) <p><u>Group C (For Area B2 or E):</u></p> <ul style="list-style-type: none"> • 2 Generator, silenced, 75dB(A) at 7m (CNP 102) • 1 Excavator, tracked (CNP 081) • 1 Lorry, with crane <p><u>Group D (For Area B2 or E):</u></p> <ul style="list-style-type: none"> • 1 Drill rig <p><u>Group E (For Area B2 or E):</u></p> <ul style="list-style-type: none"> • 2 Generator, silenced, 75dB(A) at 7m (CNP 102) • 2 Drill/Grinder, hand-held (electric) (CNP 065) • 1 Saw, circular, wood (CNP 201) • 2 Water pump, submersible (electric) (CNP 283) • 1 Air Compressor (CNP002) • 1 Bar bender and cutter (electric) (CNP 021) <p><u>Group F (For Area B, C or D):</u></p> <ul style="list-style-type: none"> • 1 Asphalt paver (CNP 004) • 1 Roller, vibratory (CNP 186) • 1 Excavator, tracked (CNP 081) <p><u>Group G (For Area F):</u></p> <ul style="list-style-type: none"> • 1 Excavator, tracked (CNP 081)
Waste Producer	5213 729 P2800 11	03/10/02	---	Generating waste at the work site
Wastewater Discharge License	No. 2946	18/12/02	18/12/07	Discharge of trade Effluent, surface run-off and all other wastewater arising from the construction site and sedimentation tank

8.3 Recommendations on site inspection findings in Site Inspections of this month

Based on the site inspection findings, the recommendations are as below:

- All stockpiles with a volume of greater than 50m³ should be covered with clean tarpaulin sheets, watering or hydro-seeding to avoid wind and water erosion;
- The heights from which fill materials are dropped should be controlled to a practical height to minimize the fugitive dust arising from unloading;
- Placing enough sand bags or other protection should be applied to prevent the slity surface runoff onto the drains system;
- Checking and maintaining all the site machines to prevent dust emission;
- Providing briefing to the concerned site staff on remedial actions, such as handling method of chemicals and chemical waste;
- Maintain good waste management at the site.

9.0 WASTE MANAGEMENT

9.1 Waste Management Audit

Waste management audit was carried out by the ET on a weekly basis. A summary of the implementation status of the mitigation measures on waste management is presented in Appendix H.



9.2 Records of Waste Quantities

All type of wastes arising from the construction work are classified into the following:

- General refuses;
- Chemical waste;
- Construction & demolition (C&D) material.

The quantities of waste for disposal in this month are summarized in Table 9.1.

Table 9.1 Summary of Quantities of Waste for Disposal in this reporting month

Type of Waste	Quantity	Disposal Location
C&D Material (Inert) (m ³)	0	Nil
C&D material (Non-inert) (m ³)	0	Nil
General Refuse (m ³)	40	Disposed at NENT Landfills
Chemical Waste (L)	0	Nil

10.0 IMPLEMENTATION STATUS

10.1 Implementation Status of Environmental Mitigation Measures

POC has been implementing the required environmental mitigation measures according to Implementation of Mitigation Measures (clause 4.2, 5.2 and 6.2) in Environmental Management Plan for Contract No. TP 35/02 Remaining Engineering Infrastructure Works for Pak Shek Kok Development Package 1 (Revision 2). A summary of the implementation status of the mitigation measures is presented in Appendix H.

Air Quality

The Contractor was reminded to water, hydro-seed or cover all the stockpiles by using clean tarpaulin sheets. The Contractor was also reminded to cleanup the access road regularly to avoid dust emission.

Noise

All mitigation measures stated in Appendix I were implemented properly in this reporting month.

Water Quality

The Contractor was reminded to provide more effort to implement mitigation measures, such as diverting site runoff to suitable treatment processes before discharge, sedimentation system and drainage facilities (e.g. sedimentation trap and U-channels), and remove the sand/rubbish accumulated in the drain / channel regularly.

Waste Management

POC has been implementing most mitigation measures on waste management.

10.2 Implementation Status of Event and Action Plan

There were no exceedances in air quality and noise monitoring parameters recorded in this monitoring month. No further mitigation measures were required.

10.3 Implementation Status of Environmental Complaint Handling

No complaints had been received during this monitoring month.



11.0 CONCLUSION

Impact monitoring of air quality and noise were carried out at designated locations in accordance with the EM&A Manual in this reporting month.

According to the summary of air and noise monitoring results, no exceedances of Action and Limit Level of 24-hour and 1-hour TSP monitoring results were recorded during the reporting month. Besides, no day-time, evening-time and holiday noise levels were recorded at all monitoring stations exceeded the Action and Limit Level in this reporting month. No night-time noise monitoring were required since no construction works were processed during the night-time period.

During the restricted hours, ET found that the PMEs used complied with the requirements stated in the valid CNP and no PMEs other than ones specified in the CNP to be used in the site.

According to the ET weekly site inspections and IEC monthly site audit carried out this month, it indicated that site practices of the POC were generally undertaken in an environmentally acceptable manner and the overall site environmental performance was satisfactory.

12.0 FUTURE KEY ISSUES

12.1 Upcoming EM&A Schedule in coming two months

The Proposed EM&A program in coming two months are presented as following table:

Table 12.1 – Upcoming EM&A Schedule in coming two months

Type of Monitoring	November 2004	December 2004
Noise Monitoring (Day-time)	02, 09, 16, 23, 30	07, 14, 21, 28
Noise Monitoring (Evening-time)	02, 09, 16, 23, 30	07, 14, 21, 28
Noise Monitoring (Holiday)	07, 14, 21, 28	05, 12, 19, 26
1-hour TSP	02, 04, 06, 09, 11, 13, 16, 18, 20, 23, 25, 27, 30	02, 04, 07, 09, 11, 14, 16, 18, 21, 23, 24, 28, 30
24-hour TSP	01, 06, 11, 18, 24, 30	06, 11, 17, 23, 29
Site Inspection	06, 13, 20, 27	02, 09, 16, 23, 30

12.2 Upcoming construction works schedule in the coming month

The major construction works planned to be carried out in next two months and their possible impact is tabulated (Table 12.2) for reference.

Table 12.2 – Construction Plan in the coming month

Month	Works Planned to be Carried Out
Between November and December 2004	▪ Drainageworks in Zone P and Area 15
	▪ Watermain installation works
	▪ Roadworks at Zone P and Area 15
	▪ Drainage and Watermain under KCRC bridge
	▪ Construction of Road D1 Bridge
	▪ Construction of pumping station no.1 and no.2
	▪ Rectification of jogging track and cross-link fence in HKIED




Appendix A

Organization Chart and Lines of Communication

Project Site Organization Chart

Rev. K

Date: 03-Aug-04

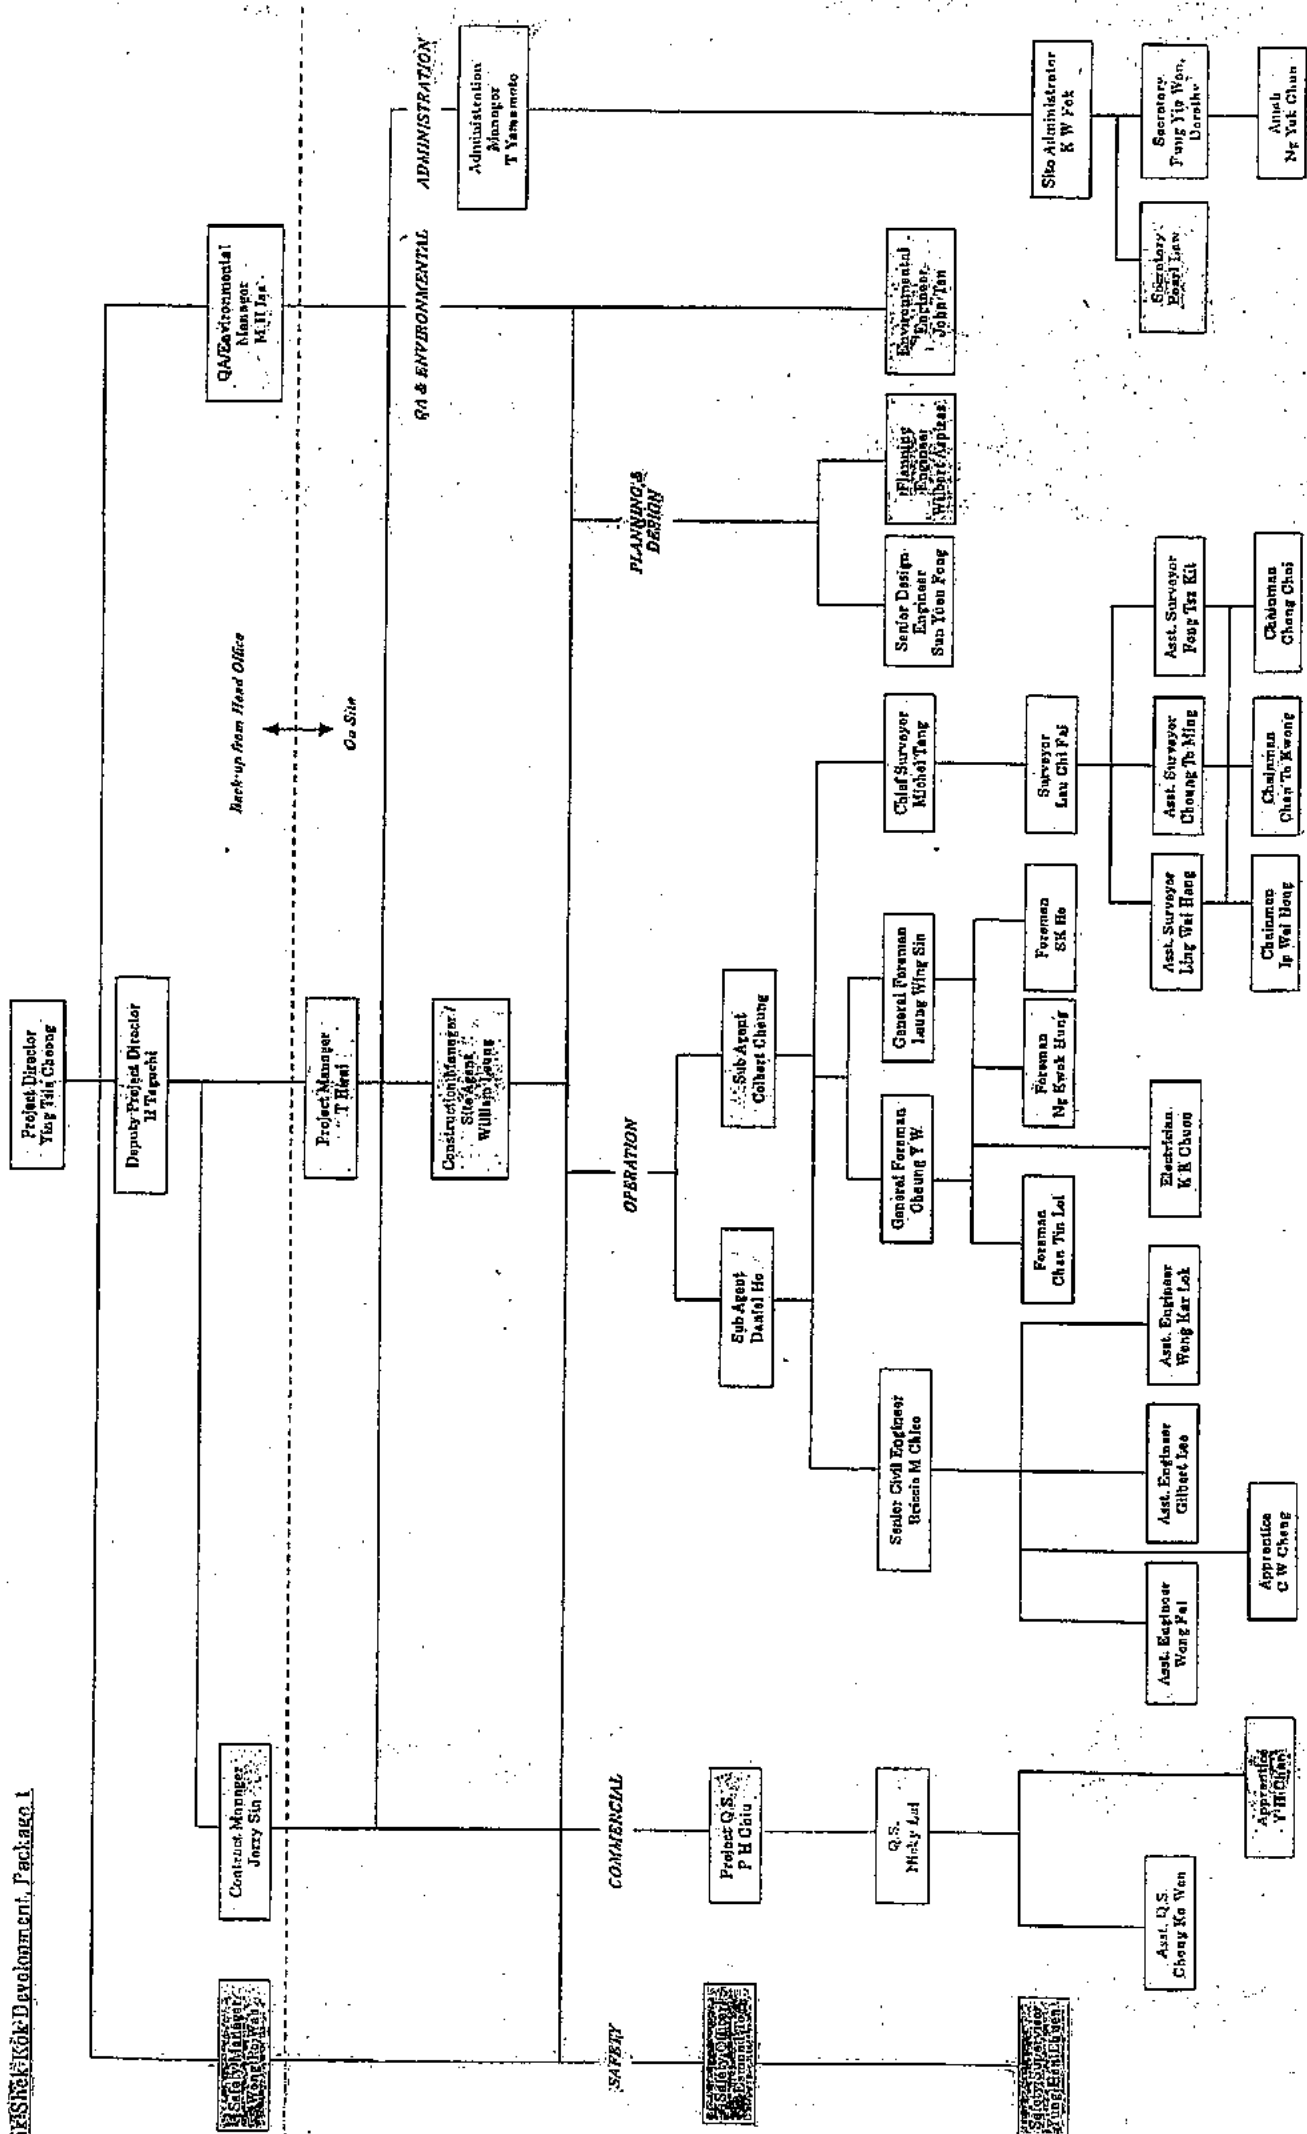

QA & ENVIRONMENTAL ADMINISTRATION

Administration Manager
T Yamamoto

SAFETY

COMMERCIAL

OPERATION


PLANNING & DESIGN

Back-up from Head Office

On Site



Lines of Communication

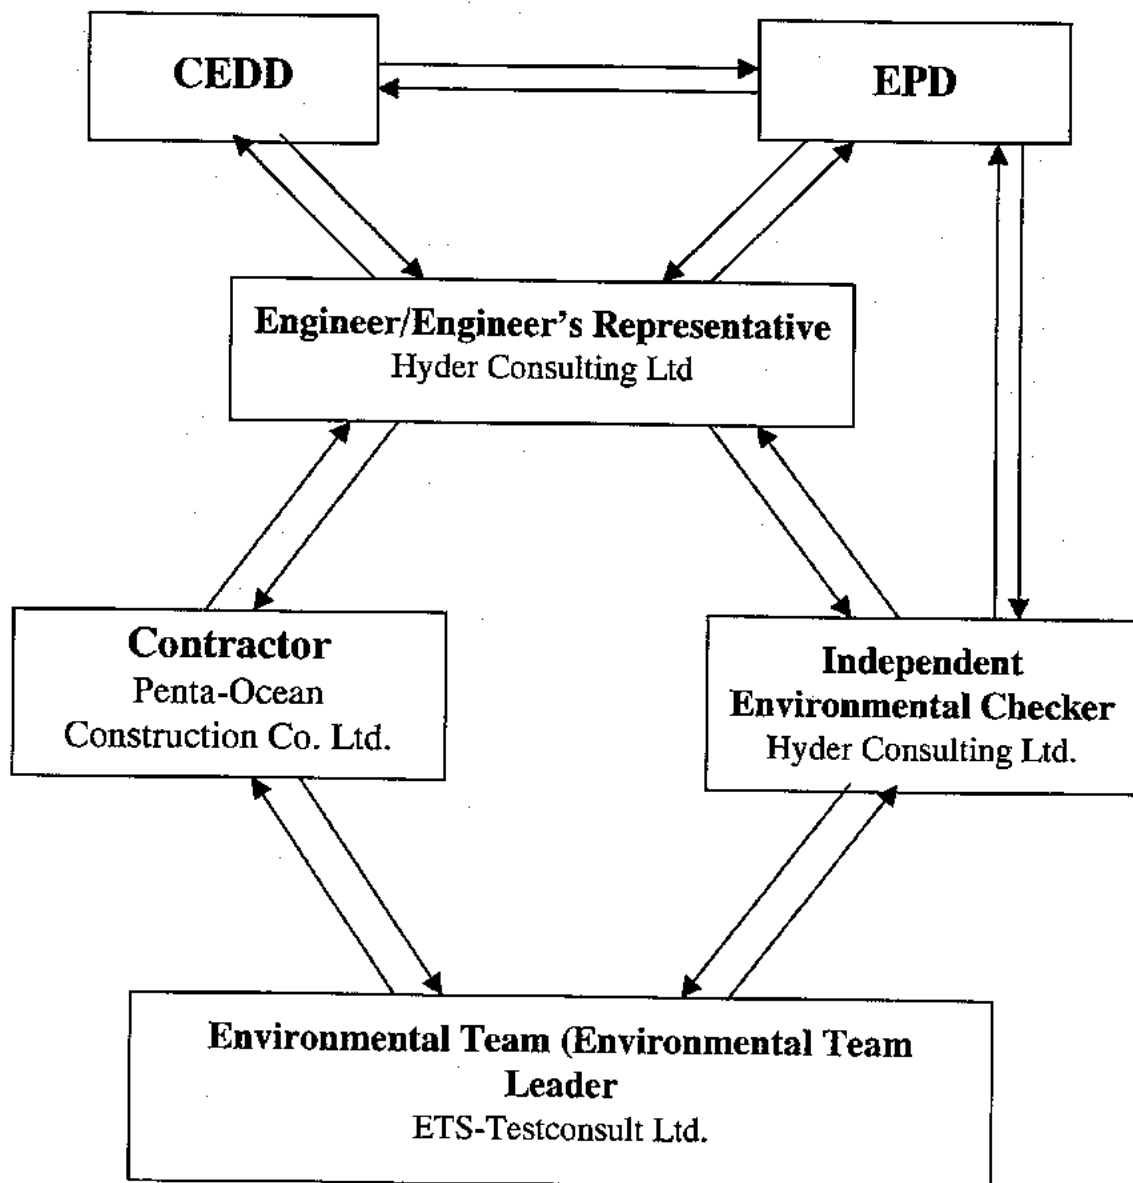



Appendix B1

Calibration Certificates for Air Quality Monitoring Equipments



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etj@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

TEST REPORT


Calibration Report
of
High Volume Air Sampler

Manufacturer : Greasby GMW Date of Calibration : 16 September 2004
Serial No. : 7179 (EA / 003 / 16) Calibration Due Date : 15 November 2004
Method : Based on Operations Manual for Graseby Model GS2310 series using calibration kit TE-5025A

Results :

Flow recorder reading (cfm)	52	46	38	28	18
Qstd (Actual flow rate, m ³ /min)	1.69	1.51	1.38	1.18	0.91
Pressure :	759.06 mm Hg		Temp. : 301 K		

Sampler 7179 Calibration Curve
Site: Pak Shek Kok (AM3A)
Date of Calibration: 16 September 2004

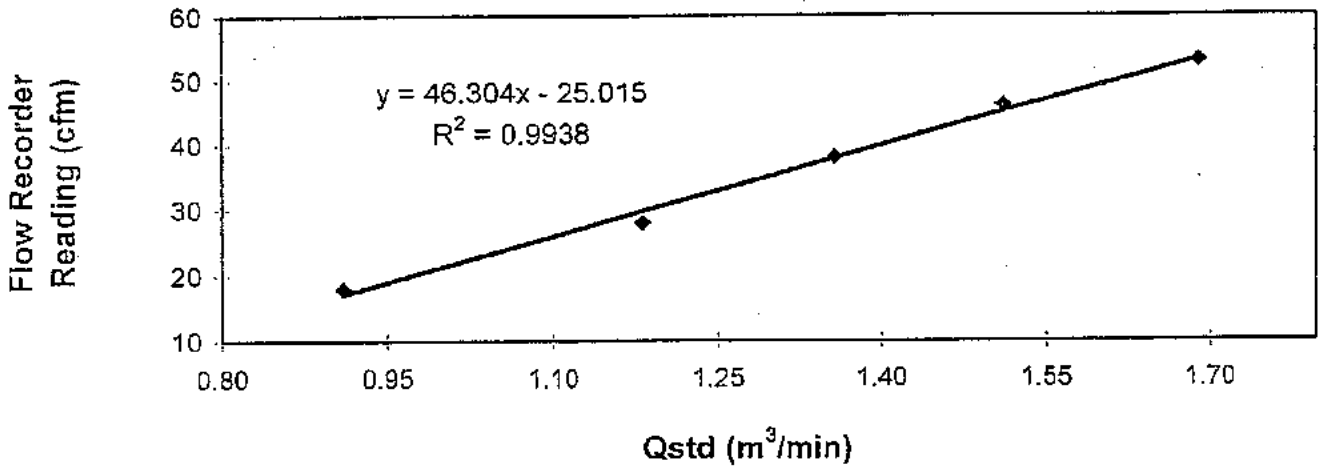

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5 point calibration

The high volume sampler complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use.

Calibrated by : Mak Kei Wai
Mak Kei Wai
(Technician)

Approved by : H. T. Chow
H. T. Chow
(Asst. Environmental Officer)



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

B/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

TEST REPORT


Calibration Report
of
High Volume Air Sampler

Manufacturer : Greasby GMW Date of Calibration : 16 September 2004
Serial No. : 1178 (EA/003/01) Calibration Due Date : 15 November 2004
Method : Based on Operations Manual for Graseby Model GS2310 series using calibration kit TE-5025A

Results :

Flow recorder reading (cfm)	51	46	40	33	26
Qstd (Actual flow rate, m ³ /min)	1.69	1.54	1.39	1.17	0.91
Pressure :	759.06 mm Hg		Temp. : 301 K		

Sampler1178 Calibration Curve
Site: Pak Shek Kok Monitoring Station AM1 (24hr.)
Date of Calibration: 16 September 2004

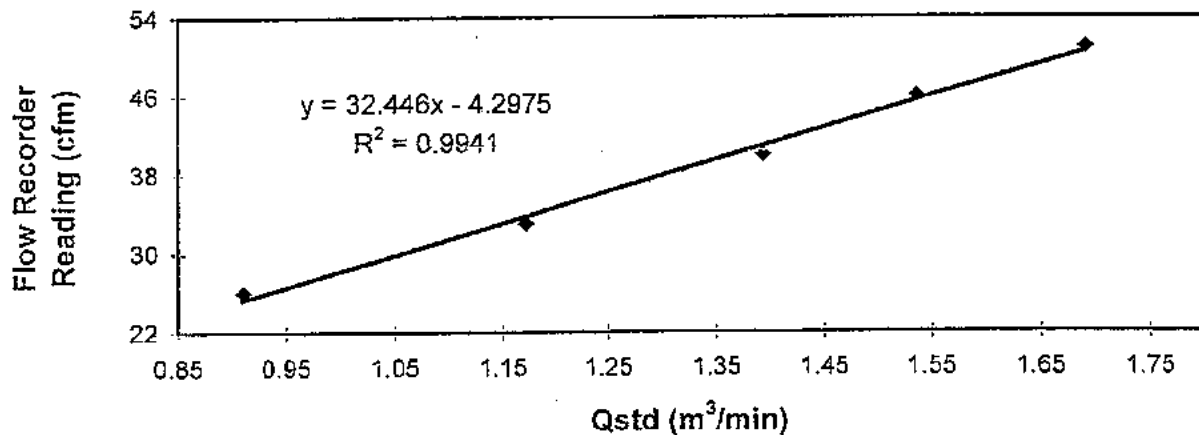

Acceptance Criteria : Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5 point calibration

The high volume sampler complies * / ~~does not comply~~ * with the specified requirements and is deemed acceptable * / ~~unacceptable~~ * for use.

Calibrated by : Mak Kei Wai
Mak Kei Wai
(Technician)

Approved by : H. T. Chow
H. T. Chow
(Asst. Environmental Officer)



Appendix B2

Air Quality Monitoring Results

Summary of 24-hr TSP Monitoring Results

Monitoring Station : AM1
 Location : HKIB Staff Accommodation

Start Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)	Weather Condition
		Date	Time	Initial	Final		Initial	Final		Initial	Final		
04/10/04	09:12	05/10/04	09:22	6638.99	6663.15	24.16	1.18	1.18	1.18	2.8734	3.0149	83	Sunny
09/10/04	08:25	10/10/04	08:29	6687.27	6711.34	24.07	1.15	1.15	1.15	2.9099	3.0463	82	Sunny
15/10/04	11:20	16/10/04	11:28	6735.28	6759.41	24.13	1.15	1.15	1.15	2.8591	3.0252	100	Sunny
20/10/04	08:56	21/10/04	08:45	6783.36	6807.18	23.82	1.15	1.15	1.15	2.8952	3.0903	119	Cloudy
26/10/04	10:10	27/10/04	10:08	6831.00	6851.96	23.96	1.15	1.15	1.15	2.8857	3.1314	149	Sunny

Monitoring Station : AM3A
 Location : Cheung Shue Tan (in front of Man Kee Store)

Start Date	Start Time	Finish		Elapse Time		Sampling Time (hrs)	Flow Rate (m ³ /min.)		Average (m ³ /min.)	Filter Weight (g)		Conc. (µg/m ³)	Weather Condition
		Date	Time	Initial	Final		Initial	Final		Initial	Final		
04/10/04	09:30	05/10/04	09:47	11976.36	12000.64	24.28	1.19	1.19	1.19	2.9028	3.0511	86	Sunny
09/10/04	11:18	10/10/04	11:45	12024.83	12049.28	24.45	1.17	1.17	1.17	2.8955	3.0573	94	Sunny
15/10/04	11:38	16/10/04	12:04	12073.57	12098.00	24.43	1.17	1.17	1.17	2.8730	3.0332	93	Sunny
20/10/04	09:16	21/10/04	09:43	12122.34	12146.79	24.45	1.19	1.19	1.19	2.8778	3.0892	121	Cloudy
26/10/04	11:32	27/10/04	11:00	12171.01	12194.47	23.46	1.19	1.19	1.19	2.8988	3.0801	108	Sunny

Summary of 1-hr TSP Monitoring Results

Monitoring Station : AM1
Location : HKIB Staff Accommodation

Date	Monitoring Period		1-hr TSP ($\mu\text{g}/\text{m}^3$)				Weather
	Start	Finish	Minimum	Maximum	Average		
02/10/04	14:08	15:08	58	303	115	Sunny	
05/10/04	08:50	09:50	110	621	236	Sunny	
07/10/04	08:20	09:20	62	381	122	Sunny	
09/10/04	08:20	09:20	59	336	125	Sunny	
12/10/04	08:38	09:38	52	369	118	Sunny	
14/10/04	09:10	10:10	55	388	114	Sunny	
16/10/04	14:48	15:48	50	412	126	Sunny	
19/10/04	08:35	09:35	36	295	103	Sunny	
21/10/04	09:30	10:30	90	362	163	Cloudy	
23/10/04	13:00	14:00	49	312	131	Sunny	
26/10/04	08:20	09:20	40	383	117	Sunny	
28/10/04	08:50	09:50	56	442	130	Sunny	
30/10/04	13:30	14:30	48	392	104	Sunny	

Monitoring Station : AM3
Location : Cheung Shue Tan Village (near the outer building, a temple)

Date	Monitoring Period		1-hr TSP ($\mu\text{g}/\text{m}^3$)				Weather
	Start	Finish	Minimum	Maximum	Average		
02/10/04	16:22	17:22	45	256	89	Sunny	
05/10/04	10:45	11:45	150	543	220	Sunny	
07/10/04	14:32	15:32	49	242	109	Sunny	
09/10/04	11:14	12:14	50	241	87	Sunny	
12/10/04	13:05	14:05	46	323	101	Sunny	
14/10/04	14:42	15:42	50	284	119	Sunny	
16/10/04	17:02	18:02	35	294	77	Sunny	
19/10/04	14:08	15:08	32	277	95	Sunny	
21/10/04	11:00	12:00	67	306	126	Cloudy	
23/10/04	15:18	16:18	38	260	92	Sunny	
26/10/04	13:20	14:20	34	290	88	Sunny	
28/10/04	14:05	15:05	42	290	95	Sunny	
30/10/04	15:45	16:45	40	252	88	Sunny	




Appendix B3


Graphical Plots of Air Quality Monitoring Data



1-hour TSP level at AM1, HKIB Staff Accommodation

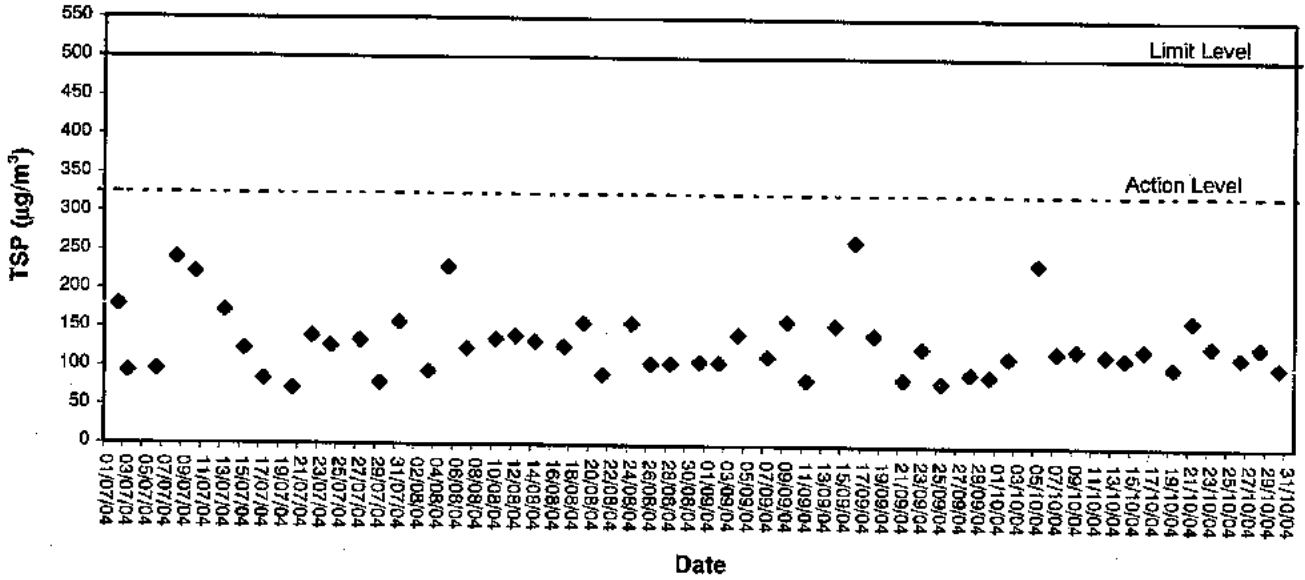


1-hour TSP level at AM3, Cheung Shue Tan Village (near the outer building, a temple)

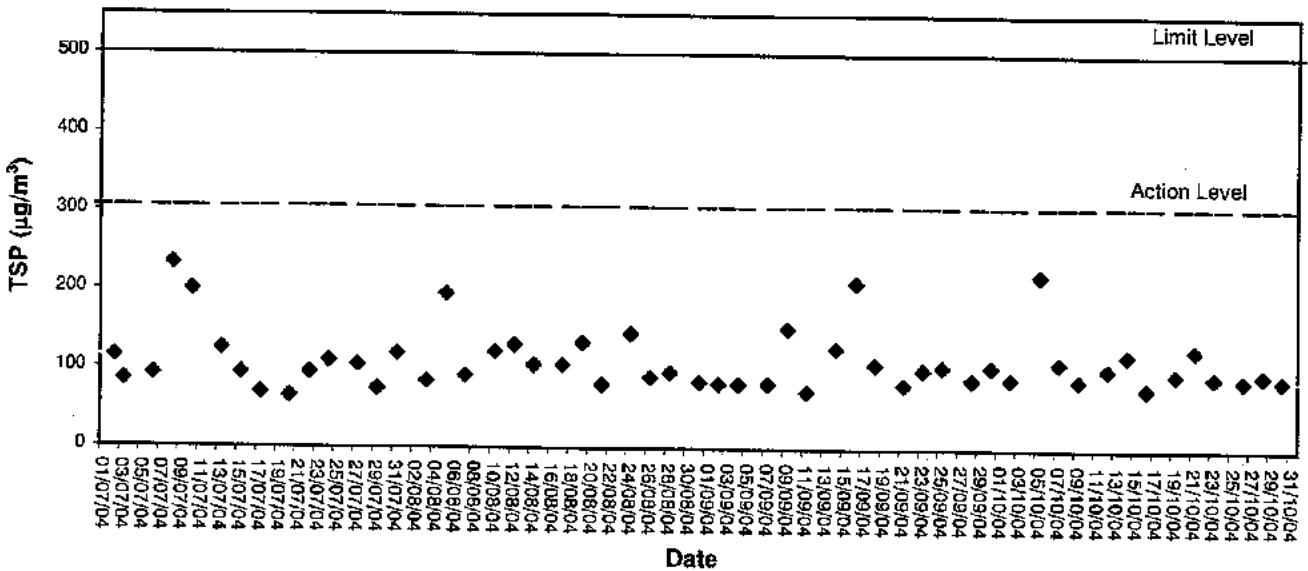




24-hour TSP level at AM1 (HKIB Staff Accommodation)

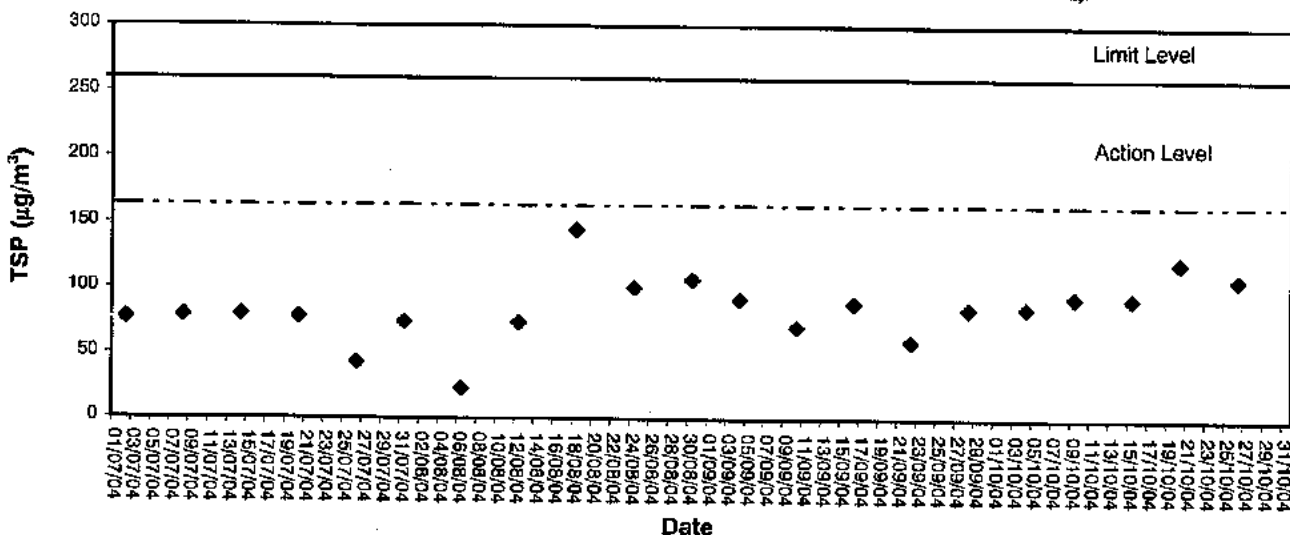

24-hour TSP level at AM3A (Cheung Shue Tan in front of Man Kee Store)

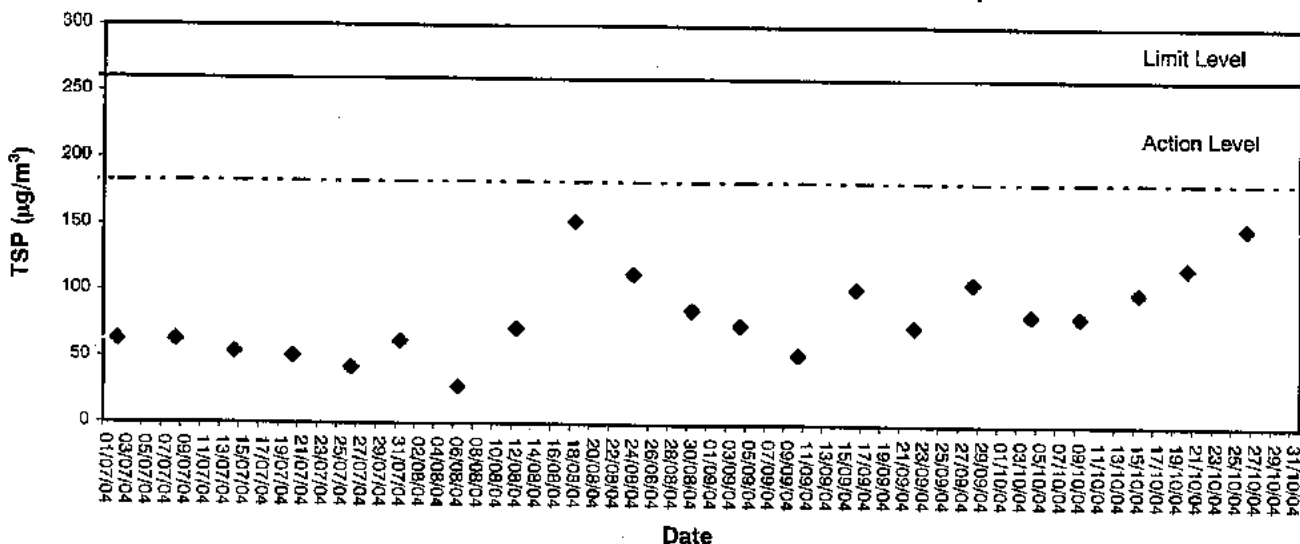



Appendix C1

Calibration Certificates for Noise Monitoring Equipments



Calibration Certificate

Certificate No. 41649

Page 1 of 2 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q40536

Date of receipt : 6-Apr-04

Item Tested

Description : Sound Level Calibrator (ET/0527/002)

Manufacturer : Rion

Model : NC-73

Serial No. : 10644871

Test Conditions

Date of Test : 16-Apr-04

Supply Voltage : -

Ambient Temperature : $(22.5 \pm 2.5)^{\circ}\text{C}$

Relative Humidity : $(50 \pm 20) \%$

Test Specifications

Calibration check according to customer's requirement.

Calibration procedure : F21, Z02.

Test Results

All results were within the manufacturer's specification.

The results are shown in the attached page(s).

Test equipment used:

<u>Equipment No.</u>	<u>Cert. No.</u>	<u>Due Date</u>	<u>Traceable to</u>
S014	30961	1-Jun-04	PRC-NIM
S024	Z02050078	29-May-04	PRC-NIM
S041	35075	2-Dec-04	PRC-NIM

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to national standards/International System of Units (SI).
The test results apply to the above Unit-Under-Test only

Calibrated by : 

Approved by : 

Alan Chu - Manager

Date: 16-Apr-04

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646

All rights reserved. This certificate is owned by Hong Kong Calibration Ltd. It may not be reproduced except in full.



Calibration Certificate

Certificate No. 41649

Page 2 of 2 Pages

Results :

1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94 dB	- 0.8 dB	± 1 dB

Uncertainty : ± 0.2 dB

2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	0.986 kHz	± 2 %

Uncertainty : ± 0.1 %

3. Level Stability : 0.0 dB

Uncertainty : ± 0.01 dB

4. Total Harmonic Distortion : < 0.2 %

Mfr's Spec. : < 3 %

Uncertainty : ± 2.3 % of reading

Remark : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure : 995 hPa

4. The above measured values are the mean of 3 measurement.

----- END -----



Calibration Certificate

Certificate No. 41648

Page 1 of 3 Pages

Customer : ETS-Testconsult Limited

Address : 8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan St., Fotan, Hong Kong.

Order No. : Q40536

Date of receipt : 6-Apr-04

Item Tested

Description : Precision Integrating Sound Level Meter

Manufacturer : Rion

Model : NL-31

Serial No. : 00531142

Test Conditions

Date of Test : 16-Apr-04

Supply Voltage : -

Ambient Temperature : (22.5 ± 2.5)°C

Relative Humidity : (50 ± 20) %

Test Specifications

Calibration check according to customer's requirement.

Calibration procedure : Z01.

Test Results

All results were within the manufacturer's, IEC 651 Type 1, IEC 804 Type 1 specification.

The results are shown in the attached page(s).


Test equipment used:

<u>Equipment No.</u>	<u>Cert. No.</u>	<u>Due Date</u>	<u>Traceable to</u>
S017	S30857	8-Apr-05	PRC-NIM
S024	Z02050078	29-May-04	PRC-NIM

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to national standards/International System of Units (SI).
The test results apply to the above Unit-Under-Test only

Calibrated by : 

Approved by : 
Alan Chu - Manager

Date: 16-Apr-04



Calibration Certificate

Certificate No. 41648

Page 2 of 3 Pages

Results :

1. SPL Accuracy

UUT Setting			UUT Reading (dB)	Correction (dB)
Level Range (dB)	Weight	Response		
20 - 100	L _A	Fast	94.0	+ 0.1
		Slow		+ 0.1
	L _C	Fast		+ 0.1
	L _p	Fast		0.0
30 - 120	L _A	Fast	94.0	+ 0.1
		Slow		+ 0.1
	L _C	Fast		+ 0.1
	L _p	Fast		0.0
30 - 120	L _A	Fast	114.0	0.0
		Slow		0.0
	L _C	Fast		0.0
	L _p	Fast		0.0

IEC 651 Type 1 Spec. : ± 0.7 dB

Uncertainty : ± 0.2 dB

2. Level Stability : 0.0 dB

IEC 651 Type 1 Spec. : ± 0.3 dB

Uncertainty : ± 0.01 dB



Calibration Certificate

Certificate No. 41648

Page 3 of 3 Pages

3. Frequency Weighting

A weighting

Frequency	Attenuation (dB)	IEC 651 Type 1 Spec.
31.5 Hz	- 39.5	- 39.4 dB, ± 1.5 dB
63 Hz	- 26.3	- 26.2 dB, ± 1.5 dB
125 Hz	- 16.2	- 16.1 dB, ± 1 dB
250 Hz	- 8.7	- 8.6 dB, ± 1 dB
500 Hz	- 3.3	- 3.2 dB, ± 1 dB
1 kHz	0.0 (Ref.)	0 dB, ± 1 dB
2 kHz	+ 1.3	+ 1.2 dB, ± 1 dB
5 kHz	+ 1.1	+ 1.0 dB, ± 1 dB
8 kHz	- 1.1	- 1.1 dB, + 1.5 dB ~ - 3 dB
16 kHz	- 6.7	- 6.6 dB, + 3 dB ~ ∞

Uncertainty : ± 0.1 dB

4. Time Averaging

Applied Burst duty Factor	UUT Reading (dB)	Correction (dB)	IEC 804 Type 1 Spec.
continuous	36.9	--	--
1/10	36.7	+ 0.2	± 0.5 dB
1/10 ²	36.7	+ 0.2	
1/10 ³	36.7	+ 0.2	± 1.0 dB
1/10 ⁴	36.7	+ 0.2	

Uncertainty : ± 0.1 dB

- Remark : 1. UUT : Unit-Under-Test
 2. True Value = UUT Reading + Correction.
 3. The uncertainty claimed is for a confidence probability of not less than 95%.
 4. Atmospheric Pressure : 995 hPa.

----- END -----



Appendix C2

Noise Monitoring Results



Day-time Noise Monitoring

Monitoring Location: NM1 (HKIB Staff Accommodation)

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq} (30)	L10	L90		
05/10/04	08:55	58.0	59.9	56.1	1.1	Sunny
12/10/04	09:15	59.4	62.0	53.2	0.5	Sunny
19/10/04	08:38	61.3	64.2	55.6	2.7	Sunny
26/10/04	09:28	58.7	62.1	54.0	2.1	Sunny

Monitoring Location: NM2 (CUHK Residence No.10)

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq} (30)	L10	L90		
05/10/04	10:00	55.6	58.0	53.7	0.9	Sunny
12/10/04	10:52	57.1	59.8	54.2	0.5	Sunny
19/10/04	10:50	67.2	71.3	60.1	3.5	Sunny
26/10/04	10:50	71.2	76.2	63.9	0.7	Sunny

Monitoring Location: NM3 (Cheung Shue Tan Village)

Date	Start Sampling Time (hh:mm)	Noise Level dB (A)			Wind Speed (m/s)	Weather Condition
		L _{eq} (30)	L10	L90		
05/10/04	10:50	53.6	55.8	49.1	0.5	Sunny
12/10/04	13:08	49.5	51.1	46.3	1.0	Sunny
19/10/04	15:14	45.8	48.0	43.2	1.4	Sunny
26/10/04	14:25	53.9	56.8	50.4	1.3	Sunny



Evening-time Noise Monitoring

Monitoring Location: NM1 (HKIB Staff Accommodation)

Date	Start Sampling Time	Noise Level dB (A)									Wind Speed (m/s)	Weather Condition
		L _{eq} (5)			L10			L90				
05/10/04	19:00	57.2	57.0	56.8	59.4	59.1	58.7	54.5	54.2	53.6	0.8	Fine
12/10/04	19:49	59.1	58.2	57.6	61.7	60.3	59.6	53.7	54.0	53.6	1.1	Cloudy
19/10/04	19:00	56.9	57.3	56.2	59.2	59.9	58.4	53.6	54.0	52.9	1.9	Clear
26/10/04	19:45	56.4	56.6	56.3	58.6	58.9	58.1	52.6	52.4	51.9	0.6	Fine

Monitoring Location: NM2 (CUHK Residence No.10)

Date	Start Sampling Time	Noise Level dB (A)									Wind Speed (m/s)	Weather Condition
		L _{eq} (5)			L10			L90				
05/10/04	19:25	53.7	54.0	53.9	55.8	56.2	56.0	49.4	49.9	50.2	0.4	Fine
12/10/04	20:24	58.4	56.9	57.2	60.7	59.0	59.9	53.1	52.6	53.0	1.0	Cloudy
19/10/04	19:28	60.0	59.5	60.8	63.1	63.9	63.4	53.9	53.6	53.4	0.9	Clear
26/10/04	20:10	54.2	54.5	54.0	56.7	56.9	56.2	49.4	49.8	49.6	0.4	Fine

Monitoring Location: NM3 (Cheung Shue Tan Village)

Date	Start Sampling Time	Noise Level dB (A)									Wind Speed (m/s)	Weather Condition
		L _{eq} (5)			L10			L90				
05/10/04	19:50	50.7	50.2	50.4	52.8	52.5	52.9	46.4	46.2	46.4	0.6	Fine
12/10/04	21:00	56.2	55.1	54.6	58.2	57.9	57.4	49.6	49.9	50.1	0.8	Cloudy
19/10/04	19:58	47.5	48.8	47.3	51.1	50.9	49.0	44.1	45.9	45.0	2.7	Clear
26/10/04	20:35	52.4	52.0	51.9	54.5	54.1	53.4	47.4	47.0	46.2	0.4	Fine

Holiday Noise Monitoring

Monitoring Location: NM1 (HKIB Staff Accommodation)

Date	Start Sampling Time	Noise Level dB (A)									Wind Speed (m/s)	Weather Condition
		L _{eq} (5)			L10			L90				
03/10/04	09:10	60.4	60.8	61.1	63.9	64.2	64.6	57.2	57.4	57.9	1.9	Sunny
10/10/04	13:00	59.2	58.6	58.1	60.9	60.1	60.0	56.0	55.7	55.1	1.2	Sunny
17/10/04	09:45	56.2	56.4	56.5	58.8	58.9	59.1	50.9	50.7	50.9	0.6	Sunny
24/10/04	09:18	64.0	63.2	62.9	66.7	65.6	65.0	61.2	60.4	59.8	1.3	Sunny
31/10/04	14:00	59.7	61.1	60.2	61.7	62.6	61.8	55.9	56.2	57.0	1.1	Sunny

Monitoring Location: NM2 (CUHK Residence No.10)

Date	Start Sampling Time	Noise Level dB (A)									Wind Speed (m/s)	Weather Condition
		L _{eq} (5)			L10			L90				
03/10/04	09:38	57.0	57.4	56.8	59.5	59.9	58.9	54.9	55.2	54.1	2.6	Sunny
10/10/04	13:38	57.9	58.6	56.2	59.3	59.9	58.1	52.7	54.0	53.5	1.2	Sunny
17/10/04	10:10	54.2	54.0	54.1	56.8	56.5	56.6	48.7	48.4	48.8	0.4	Sunny
24/10/04	09:50	53.3	53.9	52.8	55.2	55.7	54.7	51.4	51.9	50.2	0.5	Sunny
31/10/04	14:35	58.6	57.9	59.2	59.9	59.1	61.1	55.7	56.2	55.3	1.1	Sunny

Monitoring Location: NM3 (Cheung Shue Tan Village)

Date	Start Sampling Time	Noise Level dB (A)									Wind Speed (m/s)	Weather Condition
		L _{eq} (5)			L10			L90				
03/10/04	10:12	49.3	49.5	49.8	50.6	50.9	51.3	44.5	45.1	45.7	1.6	Sunny
10/10/04	14:15	56.1	56.7	55.7	57.9	58.2	57.2	51.9	52.6	51.7	1.0	Sunny
17/10/04	10:35	52.6	52.9	52.4	54.7	55.0	54.9	47.2	47.1	46.8	0.4	Sunny
24/10/04	10:20	49.2	49.0	48.4	51.0	50.4	49.9	46.8	46.6	46.0	0.8	Sunny
31/10/04	15:15	51.1	52.6	53.7	52.7	53.9	54.8	49.6	50.1	50.2	1.0	Sunny




Appendix C3

Graphical Plots of Noise Monitoring Data




Noise Monitoring (Day-time)


Noise level at NM1, HKIB Staff Accommodation

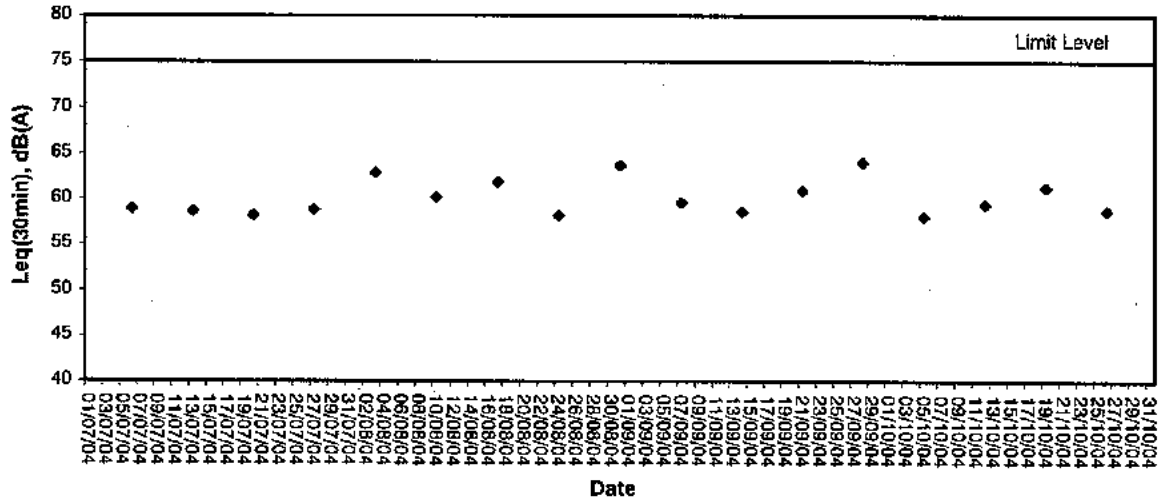

Noise level at NM2, CUHK Residence No.10

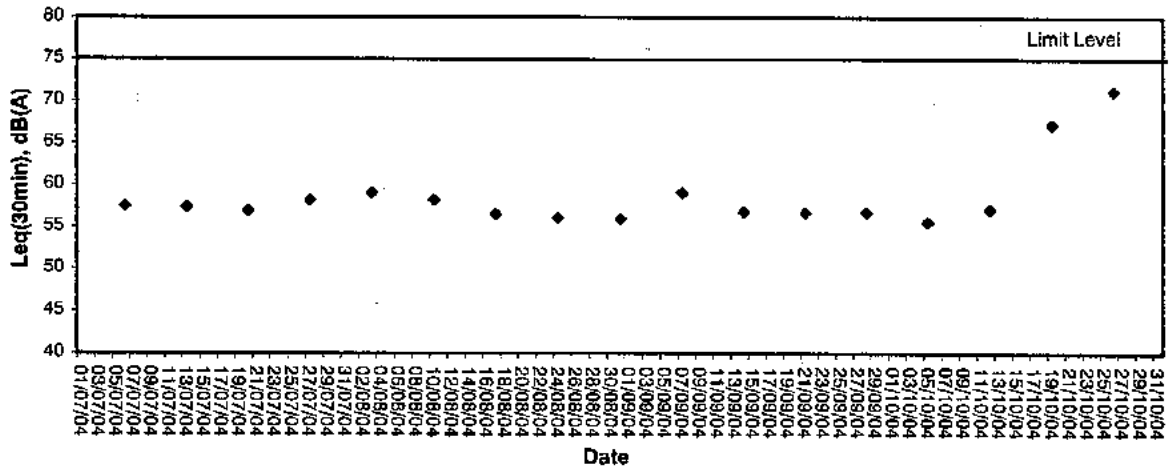


Noise level at NM3, Cheung Shue Tan Village

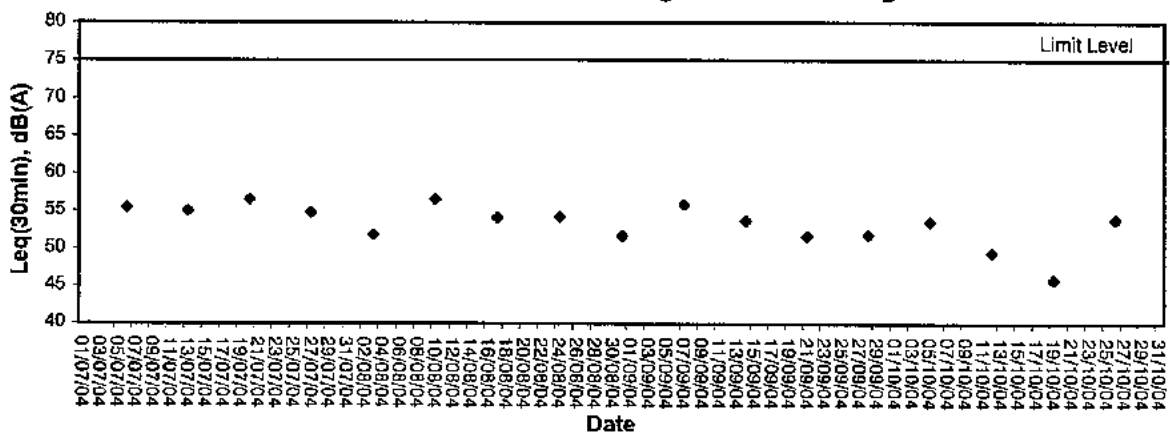




Noise Monitoring (Evening-time)


Noise level at NM1, HKIB Staff Accommodation

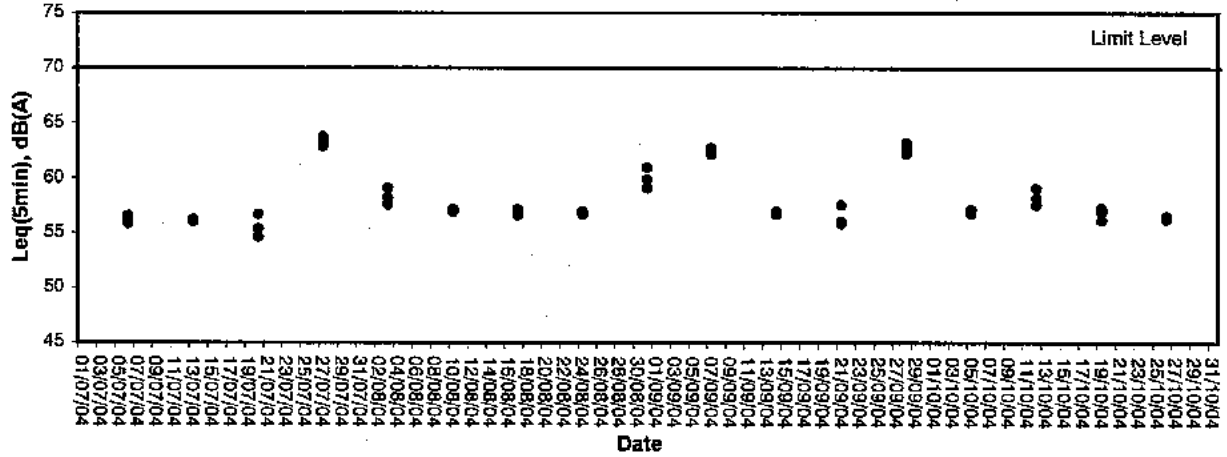

Noise level at NM2, CUHK Residence No.10

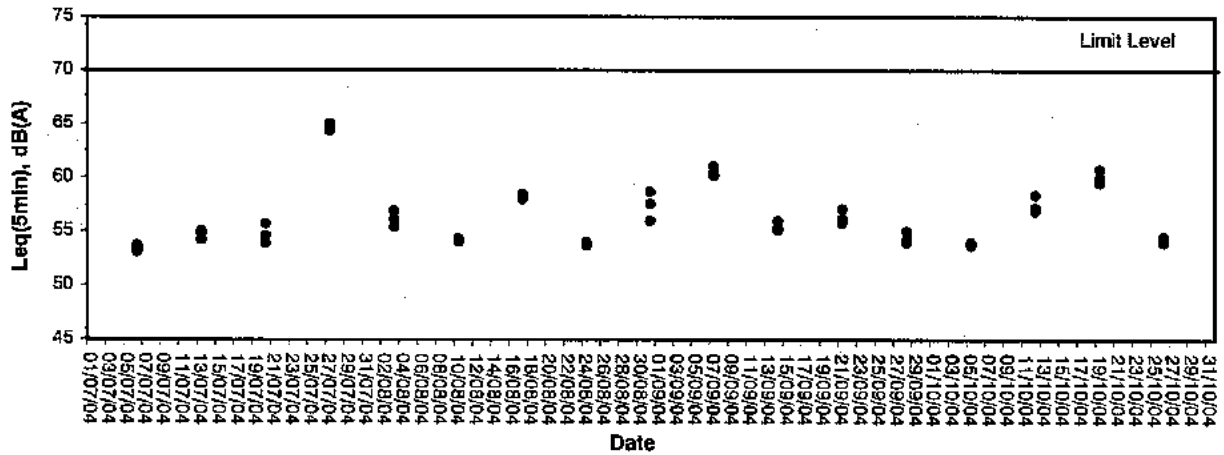


Noise level at NM3, Cheung Shue Tan Village

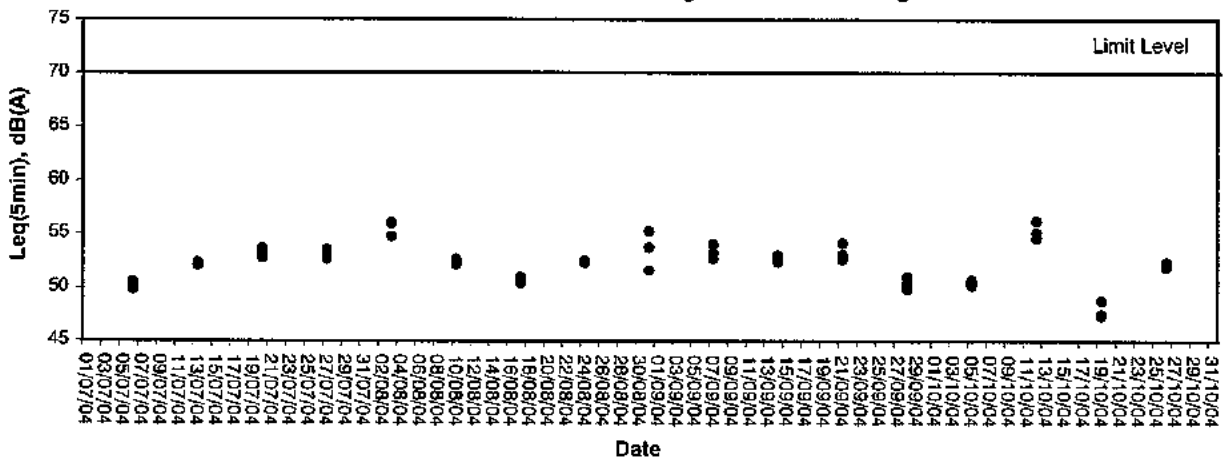




Noise Monitoring (Holiday)


Noise level at NM1, HKIB Staff Accommodation

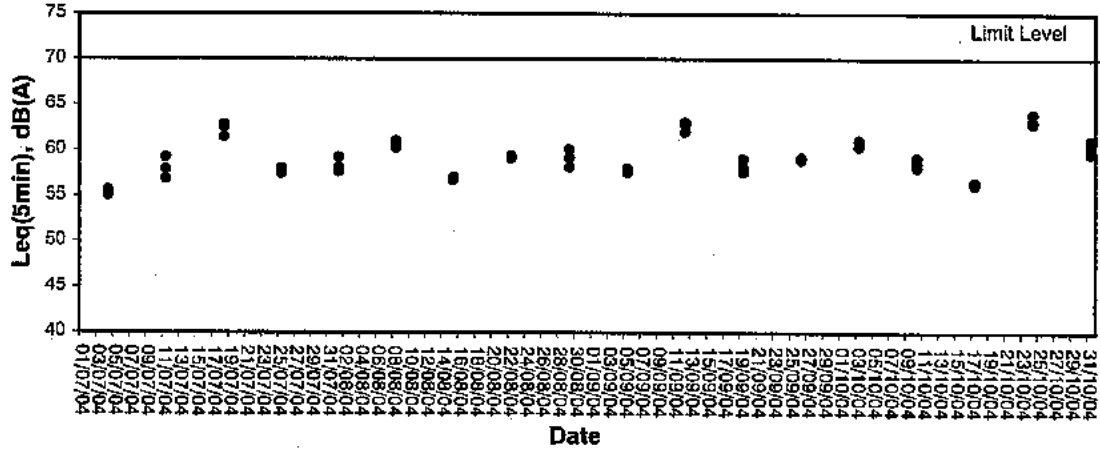

Noise level at NM2, CUHK Residence No.10

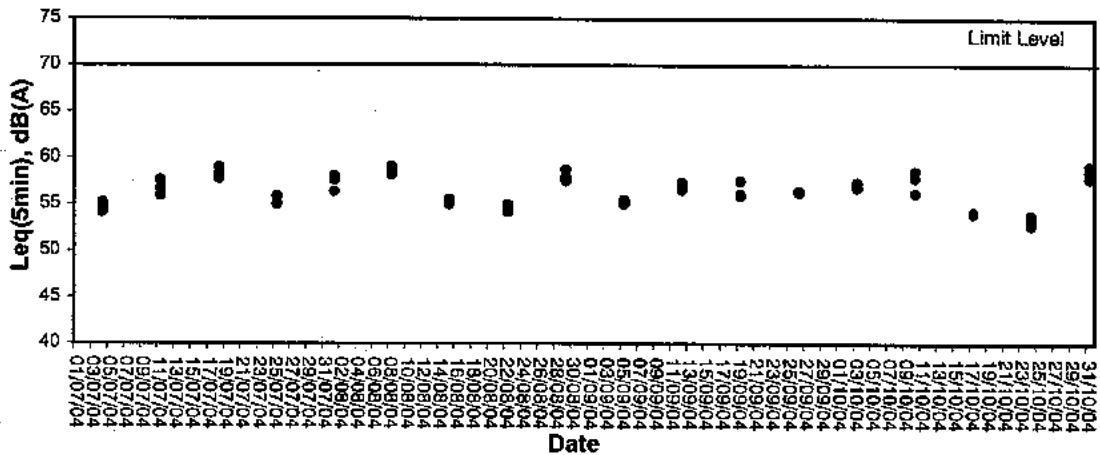

Noise level at NM3, Cheung Shue Tan Village

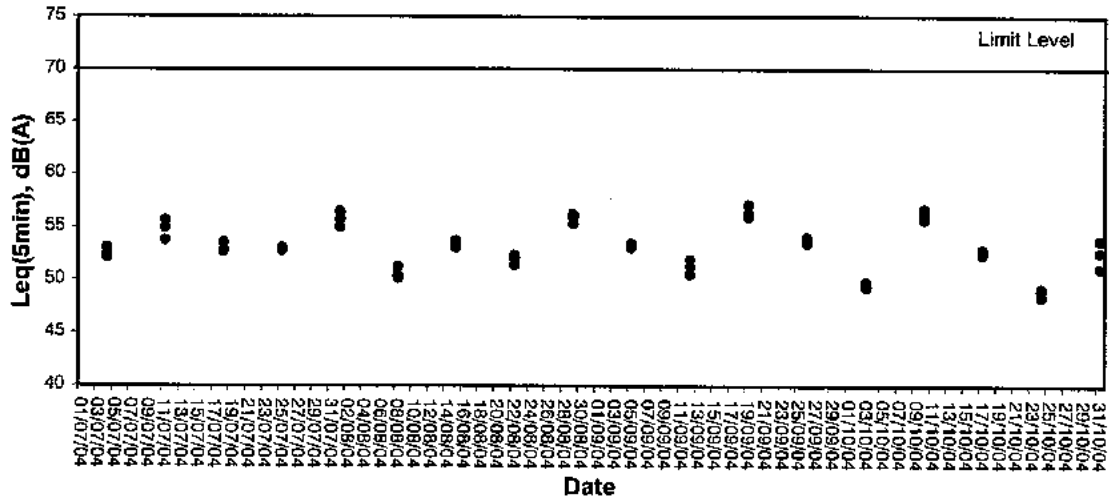



Appendix D

Weather Condition



Weather Condition

Date	Rainfall (mm)	Max. Temp (°C)	Min. Temp. (°C)	Relative Humidity (%)	Wind Direction	Wind Speed (m/s)
01/10/04	Trace	30.8	26.3	78	NE	<5
02/10/04	-	26.3	22.5	59	NE	<5
03/10/04	-	25.5	20.9	50	NE	<5
04/10/04	-	26.7	21.4	53	NE	<5
05/10/04	-	28.3	22.4	60	NE	<5
06/10/04	-	28.7	22.6	63	NE	<5
07/10/04	Trace	27.4	23.4	67	E	<5
08/10/04	-	29.0	23.0	45	N	<5
09/10/04	-	30.0	23.1	54	NE	<5
10/10/04	-	29.0	23.4	65	E	<5
11/10/04	-	29.0	23.6	73	E	<5
12/10/04	-	29.3	23.6	68	E	<5
13/10/04	-	28.9	23.5	60	E	<5
14/10/04	Trace	26.8	26.9	70	E	<5
15/10/04	-	26.7	22.7	67	E	<5
16/10/04	-	26.6	23.2	73	E	<5
17/10/04	-	26.9	22.9	73	E	<5
18/10/04	-	28.9	22.6	52	N	<5
19/10/04	-	28.4	23.3	52	N	<5
20/10/04	-	27.3	22.4	64	E	<5
21/10/04	Trace	26.4	24.2	73	E	<5
22/10/04	Trace	26.4	23.5	70	E	<5
23/10/04	-	25.8	22.7	64	E	<5
24/10/04	Trace	27.4	22.3	65	E	<5
25/10/04	-	28.6	23.1	56	N	<5
26/10/04	2.3	27.9	21.9	58	NE	<5
27/10/04	Trace	25.3	21.3	66	E	<5
28/10/04	Trace	24.8	22.2	74	E	<5
29/10/04	-	25.5	22.2	42	E	<5
30/10/04	-	26.0	22.6	76	E	<5
31/10/04	-	26.3	22.4	76	E	<5

Remark: Data of wind speed and wind direction were extracted from Hong Kong Observatory (Shatin Station).



Appendix E

Event-Action Plans



Event / Action Plan for Air Quality

EVENT	ACTION				CNTRACTOR
	ET Leader	IC(E)	ER		
<p>Action Level</p> <p>1. Exceedance of one sample</p> <p>2. Exceedance for two more consecutive samples</p>	<p>1. Identify source</p> <p>2. Inform IC(E) and ER</p> <p>3. Repeat measurement to confirm finding</p> <p>4. Increase monitoring frequency to daily</p> <p>1. Identify source</p> <p>2. Inform IC(E) and ER</p> <p>3. Repeat measurement to confirm findings</p> <p>4. Increase monitoring frequency to daily</p> <p>5. Discuss with IC(E) and Contractor on remedial actions required</p> <p>6. If exceedance continuous, arrange meeting with IC(E) and ER</p> <p>7. If exceedance stops, cease additional monitoring</p>	<p>1. Check monitoring data submitted by ET</p> <p>2. Check Contractor's working method.</p> <p>1. Checking monitoring data submitted by ET</p> <p>2. Check Contractor's working method</p> <p>3. Discuss with ET and Contractor on possible remedial measures</p> <p>4. Advise the ER on the effectiveness of the proposed remedial measures</p> <p>5. Supervisor implementation of remedial measures</p>	<p>1. Notify Contractor</p> <p>1. Confirm receipt of notification of failure in writing</p> <p>2. Notify Contractor</p> <p>3. Ensure remedial measures properly implemented</p>	<p>1. Rectify any unacceptable practice</p> <p>2. Amend working methods if possible</p> <p>1. Submit proposals for remedial action to IC(E) within 3 working days of notification</p> <p>2. Implement the agreed proposals</p> <p>3. Amend proposal if possible</p>	
<p>Limit Level</p> <p>1. Exceedance of one sample</p> <p>2. Exceedance for two or more consecutive samples</p>	<p>1. Identify source</p> <p>2. Inform ER and EPD</p> <p>3. Repeat measurement to confirm finding</p> <p>4. Increase monitoring frequency to daily</p> <p>5. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results</p> <p>1. Notify IC(E), ER, Contractor and EPD</p> <p>2. Identify source</p> <p>3. Repeat measurement to confirm findings</p> <p>4. Increase monitoring frequency to daily</p> <p>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented</p> <p>6. Arrange meeting with IC(E) and ER to discuss the remedial actions to be taken</p> <p>7. Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER to discuss the remedial action to be taken</p> <p>8. If exceedance stops, cease additional monitoring</p>	<p>1. Check monitoring data submitted by ET</p> <p>2. Check Contractor's working method.</p> <p>3. Discuss with ET and Contractor on possible remedial measures</p> <p>4. Advise the ER on the effectiveness of the proposal remedial measures</p> <p>5. Supervisor implementation of remedial measures</p> <p>1. Check monitoring data submitted by ET</p> <p>2. Check Contractor's working method.</p> <p>3. Discuss with ET and Contractor on possible remedial measures</p> <p>4. Advise the ER on the effectiveness of the proposal remedial measures</p> <p>5. Supervisor implementation of remedial measures</p>	<p>1. Confirm receipt of notification of failure in writing</p> <p>2. Notify Contractor</p> <p>3. Ensure remedial measures properly implemented</p> <p>1. Confirm receipt of notification of failure in writing</p> <p>2. Notify Contractor</p> <p>3. In consultation with the IC(E), agreed with the Contractor on the remedial measures to be implemented</p> <p>4. Ensure remedial measures properly implemented</p> <p>5. If exceedance continues, consider what portion of this work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</p>	<p>1. Take immediate action to avoid further exceedance</p> <p>2. Submit proposal for remedial actions to IC(E) within 3 working days of notification</p> <p>3. Implement the agreed proposals</p> <p>4. Amend proposal if appropriate</p> <p>1. Take immediate action to avoid further exceedance</p> <p>2. Submit proposals for remedial actions to IC(E) within 3 working days of notification</p> <p>3. Implement the agreed proposals</p> <p>4. Resubmit proposals if possible still not under control</p> <p>5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.</p>	


Event / Action Plan for Construction Noise

EVENT	ACTION			CNTRACTOR
	ET Leader	IC(E)	ER	
Action Level	<ol style="list-style-type: none"> 1. Notify IC(E) and Contractor 2. Carry out investigation 3. Report the results of investigation to the IC(E) and Contractor 4. Discuss with the Contractor and formulate remedial measures 5. Increase monitoring frequency to check mitigation effectiveness 	<ol style="list-style-type: none"> 1. Review the analyzed results submitted by the ET 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly 3. Supervise the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analyzed noise problem 4. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposal to IC(E) 2. Implement noise mitigation proposals
Limit Level	<ol style="list-style-type: none"> 1. Notify IC(E), ER, and Contractor 2. Identify source 3. Repeat measurement to confirm findings 4. Increase monitoring frequency 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented 6. Inform IC(E), ER and EPD the causes & action taken for the exceedances 7. Assess effectiveness of Contractor's remedial action and keep IC(E), EPD and ER informed to the results 8. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET and Contractor on the potential remedial actions 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly 3. Supervise the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analysed noise problem 4. Ensure remedial measures are properly implemented 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IC(E) within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated



Appendix F


Construction Programme

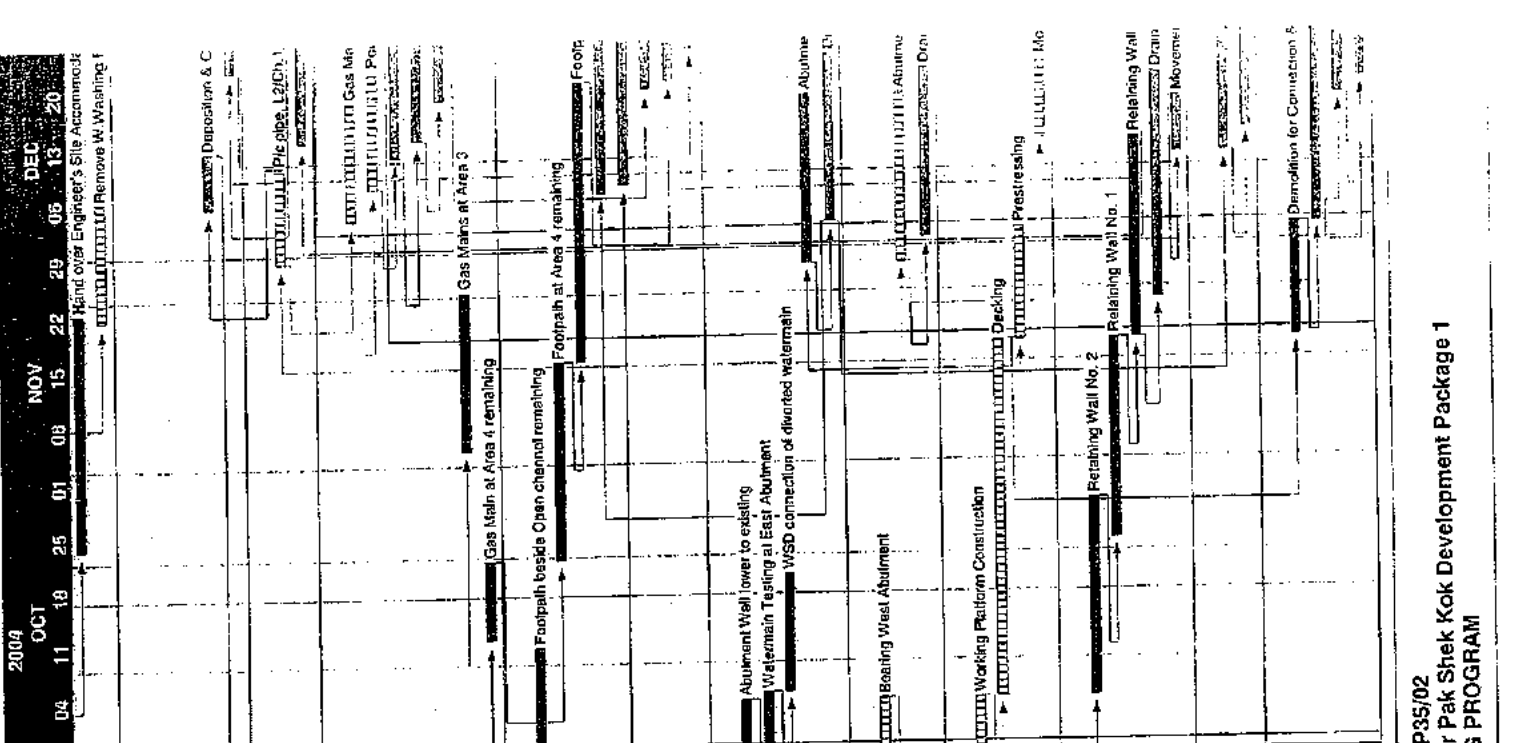


Act ID	Description	Orig Dur	Early Start	Early Finish	Percent Complete
B1-0101C0	Hand over Engineer's Site Accommodation	30	26OCT04	23NOV04	0
B1-0103K1	Rampover W.Washing Facilities, WB1 at Zone E	15	23NOV04	07DEC04	0
Section 3-Works in Areas 3,4+6, except Sec.4-1 S&EW					
B3-0308M1	Deposition & Compaction, L2/Ch.100-200	7	07DEC04	13DEC04	0
B3-0308M2	Deposition & Compaction, D1/Ch.780-920	10	24DEC04	02JAN05	0
B4-0317D1	P/c pipes, L2/Ch.100-200 Gully works	12	30NOV04	11DEC04	0
B4-0317D2	P/c pipes, D1/Ch.780-920 remaining	14	16DEC04	29DEC04	0
SECTION 4-ROADWORKS SECTION					
UT-0300G1	Gas Mains, L2/Ch.100-200	15	05DEC04	19DEC04	0
UT-0300P1	Powers (1KV), L2/Ch.100-200	15	09DEC04	23DEC04	0
UT-0300T1A	PCCW, L2/Ch.100-200	15	13DEC04	27DEC04	0
UT-0300T1B	MGC-New Work, L2/Ch.100-200	15	15DEC04	29DEC04	0
UT-0300T1C	CATV, L2/Ch.100-200	7	20DEC04	06DEC04	0
UT-0300G4	Gas Mains at Area 3	20	06NOV04	25NOV04	0
UT-0300G4	Gas Main at Area 4 remaining	10	13OCT04	22OCT04	0
SECTION 5-ROADWORKS SECTION					
B5-0325C53	Footpath beside Open channel remaining	22	20SEP04 A	11OCT04	35
B5-0325C39	Footpath at Area 4 remaining	25	23OCT04	16NOV04	0
B5-0325C3	Footpath, Area 3	35	17NOV04	21DEC04	0
B5-0328A2	Cycle track & Footpath, D1/Ch.780-920	25	08DEC04	01JAN05	0
B5-0328C1	Roadworks, L2/Ch.100-200	30	08DEC04	07JAN05	0
B5-0328A1	Cycle track & Footpath, L2/Ch.100-200	26	21DEC04	14JAN05	0
B5-0328C2	Footpath at Area 5 under bridge	25	28DEC04	15JAN05	0
B5-0328C2	Roadworks, D1/Ch.780-920	12	28DEC04	06JAN05	0
SECTION 6-STRUCTURE EAST ABUTMENT					
B7-032120	Abutment Wall lower to existing	24	08SEP04 A	04OCT04	70
B7-032130	Watermain Testing at East Abutment	15	20SEP04 A	05OCT04	50
B7-032110	WSD connection of diverted watermain	15	06OCT04	20OCT04	0
B7-032050	Abutment Wall, Rest - East Abutment	21	28NOV04	18DEC04	0
B7-032090	Drainage & Backfill - East Abutment	21	04DEC04	24DEC04	0
SECTION 7-STRUCTURE WEST ABUTMENT					
B7-033070	Bearing West Abutment	7	28SEP04	04OCT04	0
B7-033020	Abutment Wall, Rest - West Abutment	21	28NOV04	19DEC04	0
B7-033050	Drainage & Backfill - West Abutment	21	02DEC04	22DEC04	0
SECTION 8-RETAINING WALLS					
B7-034010	Working Platform Construction	24	03JUL04 A	04OCT04	70
B7-034020	Decking	45	05OCT04	18NOV04	0
B7-034030	Prestressing	14	19NOV04	02DEC04	0
B7-034040	Retaining Wall No. 1	10	14DEC04	23DEC04	0
B7-034050	Retaining Wall No. 2	25	05OCT04	29OCT04	0
B7-035020	Retaining Wall No. 1	25	25OCT04	18NOV04	0
B7-035040	Retaining Wall No. 3	25	19NOV04	13DEC04	0
B7-035050	Drainage & Backfill	28	24NOV04	21DEC04	0
B7-035060	Movement Joint	7	12DEC04	18DEC04	0
SECTION 9-ROADWORKS					
B7-036030	Road & Drainage Works	25	12DEC04	05JAN05	0
B7-036050	Footway, Cycle Track, Paving	20	15DEC04	03JAN05	0
SECTION 10-DEMOLITION OF EXISTING BRIDGE					
B7-037020	Demolition for Connection & Excavation	14	18NOV04	02DEC04	0
B7-037030	Mobilisation Works	30	03DEC04	01JAN05	0
B7-037040	Drainage Works & Movement Joints	20	19DEC04	07JAN05	0
B7-037050	ESM Works & Finishing	25	12DEC04	14JAN05	0

Contract No. TP35/02
 Remaining Engineering Infrastructure Works for Pak Shek Kok Development Package 1
 3 MONTHS ROLLING PROGRAM

Data File	28SEP04	Early bar
Page Number	2A	Progress bar
Page Count	6A	Critical bar
Number/Version	TP35/02/31/01/25	Summary bar
Company Name	Penta-Clean Construction Co. Ltd.	Start milestone point
	© Primavera Systems, Inc.	Finish milestone point

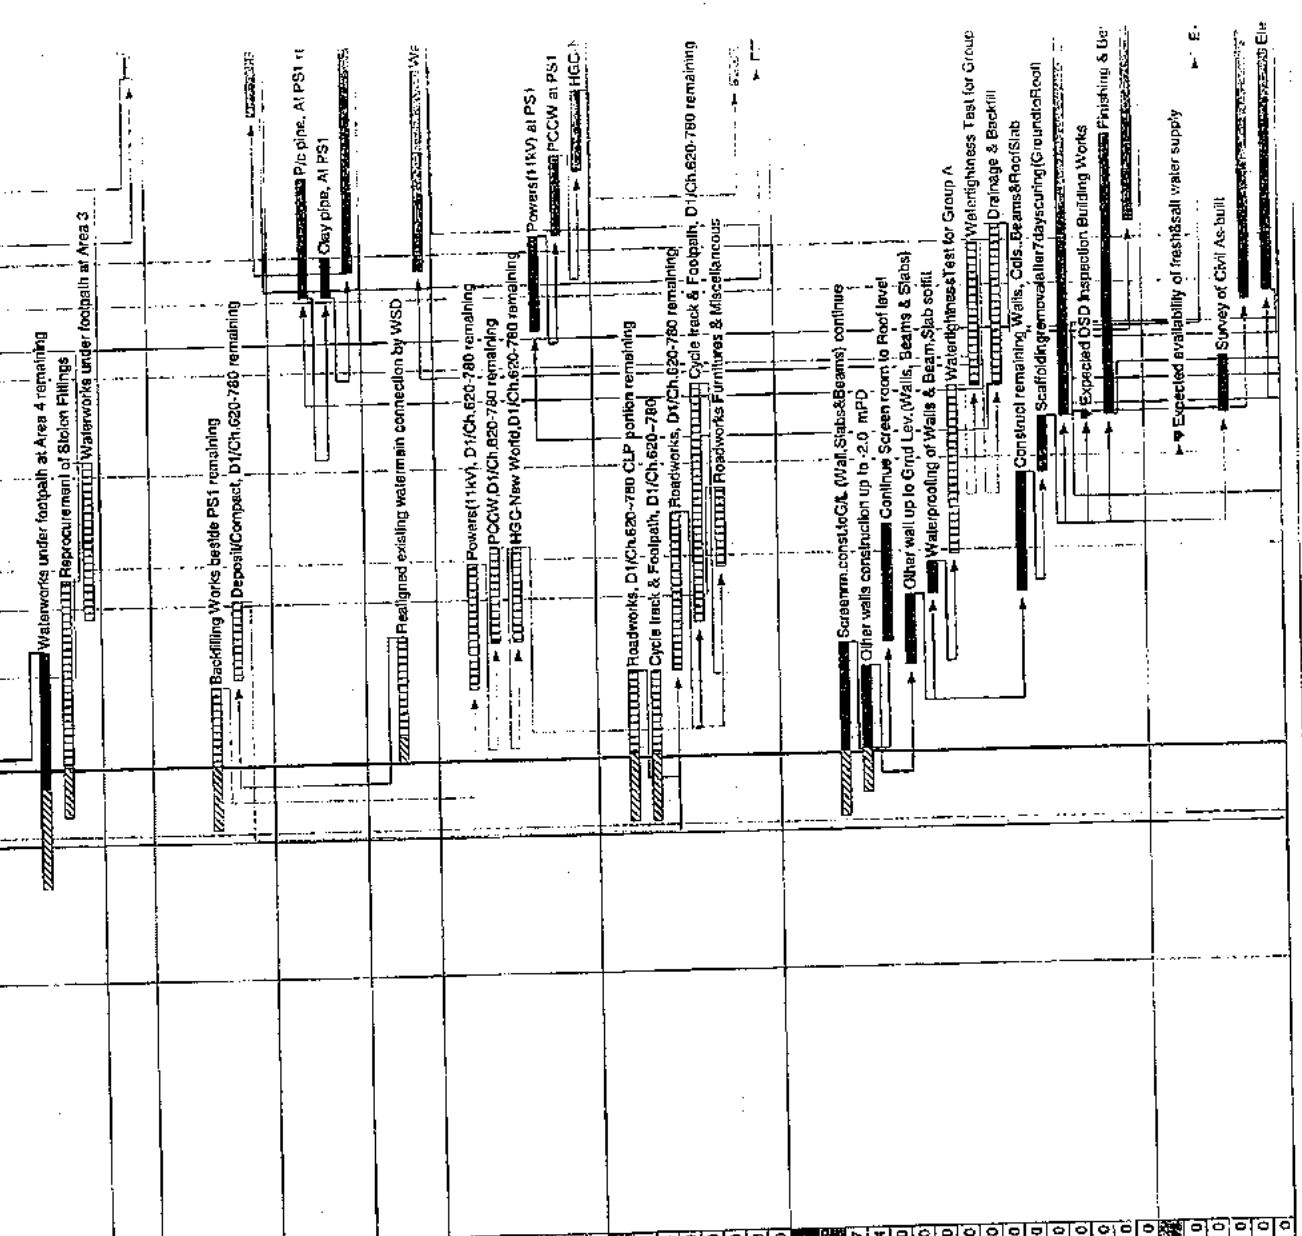

Act ID	Description	Orig Duf	Early Start	Early Finish	Percent Complete
Section 4 - Waterworks in Areas 3, 4, & 6					
Waterworks Station in Area 3					
B6-0429C7	Waterworks under footpath at Area 4 remaining	25	15SEP04 A	12OCT04	42
B6-0429C8	Reprovement of Stolen Fillings	30	22SEP04 A	21OCT04	21
B6-0429C9	Waterworks under footpath at Area 3	20	17OCT04	05NOV04	0
Waterworks Station in Area 6					
B6-0417C32	Waterworks, D1/Ch. 760-820 phase 2	7	24DEC04	30DEC04	0
Section 5 - Work in Area 7A except PumpStn. 1, 1S&EW					
Waterworks Station					
B3-0511L32	Backfilling Works beside PSI remaining	16	20SEP04 A	07OCT04	45
B3-0511L22	Deposit/Compact, D1/Ch. 620-780 remaining	10	09OCT04	18OCT04	0
B3-0512A30	Deposit/Compact, At PSI	6	18DEC04	28DEC04	0
Waterworks Station					
B4-0528F12	Pic pipe, At PSI remaining (S803-S817)	15	28NOV04	10DEC04	0
B4-0530A3	Clay Pipe, At PSI	5	28NOV04	30NOV04	0
B4-0535A1	Sewer Flushing Main, At PSI	35	28NOV04	02JAN05	0
Waterworks Station					
B6-0503A6	Realigned existing watermain connection by WSD	20	28SEP04 A	13OCT04	20
B6-0503A3	Watermain, At PSI	25	29NOV04	23DEC04	0
Waterworks Station					
UT-0500P12	Powers (11kV), D1/Ch. 620-780 remaining	16	07OCT04	22OCT04	0
UT-0500T26	POCW, D1/Ch. 620-780 remaining	12	13OCT04	24OCT04	0
UT-0500T20	HGC-New Work, D1/Ch. 620-780 remaining	12	13OCT04	24OCT04	0
UT-0500P23	Powers (11kV) at PSI	12	21NOV04	02DEC04	0
UT-0500T33A	POCW at PSI	10	03DEC04	12DEC04	0
UT-0500T38B	HGC-New Work at PSI	10	11DEC04	20DEC04	0
Waterworks Station					
B5-0540F22	Roadworks, D1/Ch. 620-780 CLP portion remaining	15	20SEP04 A	08OCT04	45
B5-0541B12	Cycle track & Footpath, D1/Ch. 620-780	20	20SEP04 A	08OCT04	44
B5-0540F2	Roadworks, D1/Ch. 620-780 remaining	20	09OCT04	28OCT04	0
B5-0541B2	Cycle track & Footpath, D1/Ch. 620-780 remaining	30	15OCT04	13NOV04	0
B5-0543E0	Roadworks Furnitures & Miscellaneous	10	22OCT04	31OCT04	0
B5-0541B3	Footpath, At PSI	15	21DEC04	04JAN05	0
B5-0540F23	Roadworks, At PSI	12	24DEC04	104JAN05	0
Section 12 - Works of Sewage Pumping Station No.1					
Waterworks Station - Finishing Works					
B5-1205S0	Screen room, const to GL (Wall, Slabs & Beams) continue	22	20SEP04 A	11OCT04	37
B5-1205T0	Other walls construction up to -2.0 mPD	17	23SEP04 A	08OCT04	34
B5-1205A0	Continue Screen room to Roof level	15	12OCT04	28OCT04	0
B5-1206T0	Other wall up to Grid Lev. (Walls, Beams & Slabs)	9	09OCT04	17OCT04	0
B5-1206S0	Waterproofing of Walls & Beam, Slab soffit	4	18OCT04	21OCT04	0
B5-1207T0	Waterlightness Test for Group A	18	23OCT04	12NOV04	0
B5-1205S0	Waterlightness Test for Group B	18	13NOV04	30NOV04	0
B5-1207T0	Construct remaining Walls, Cols., Beams & Roof Slab	20	13NOV04	02DEC04	0
B5-1205S10	Scaffolding removal after dayscutting (Ground/Roof)	15	18OCT04	01NOV04	0
B5-1209S0	Finishing & Furnitures above ground structure	7	02NOV04	06NOV04	0
B5-1207A0	Expected DSD Inspection Building Works	60	09NOV04	07JAN05	0
B5-1208T0	Finishing & Batching Works belowground chambers	35	09NOV04	13DEC04	0
B5-1207S0	Sheep Pile Extraction	25	03DEC04	27DEC04	0
Waterworks Station - Electrical Installation					
B5-1208S0	Expected availability of fresh seat water supply	0	06NOV04	0	0
B5-1205S0	Expected availability of power supply	0	24DEC04	0	0
B5-1260T0	Survey of Civil As-built	7	09NOV04	15NOV04	0
B5-1241T00	LV Switchboard and Control Panels	20	28NOV04	20DEC04	0
B5-1260S0	Electrical Installation - Concealed Conduit	30	24NOV04	23DEC04	0

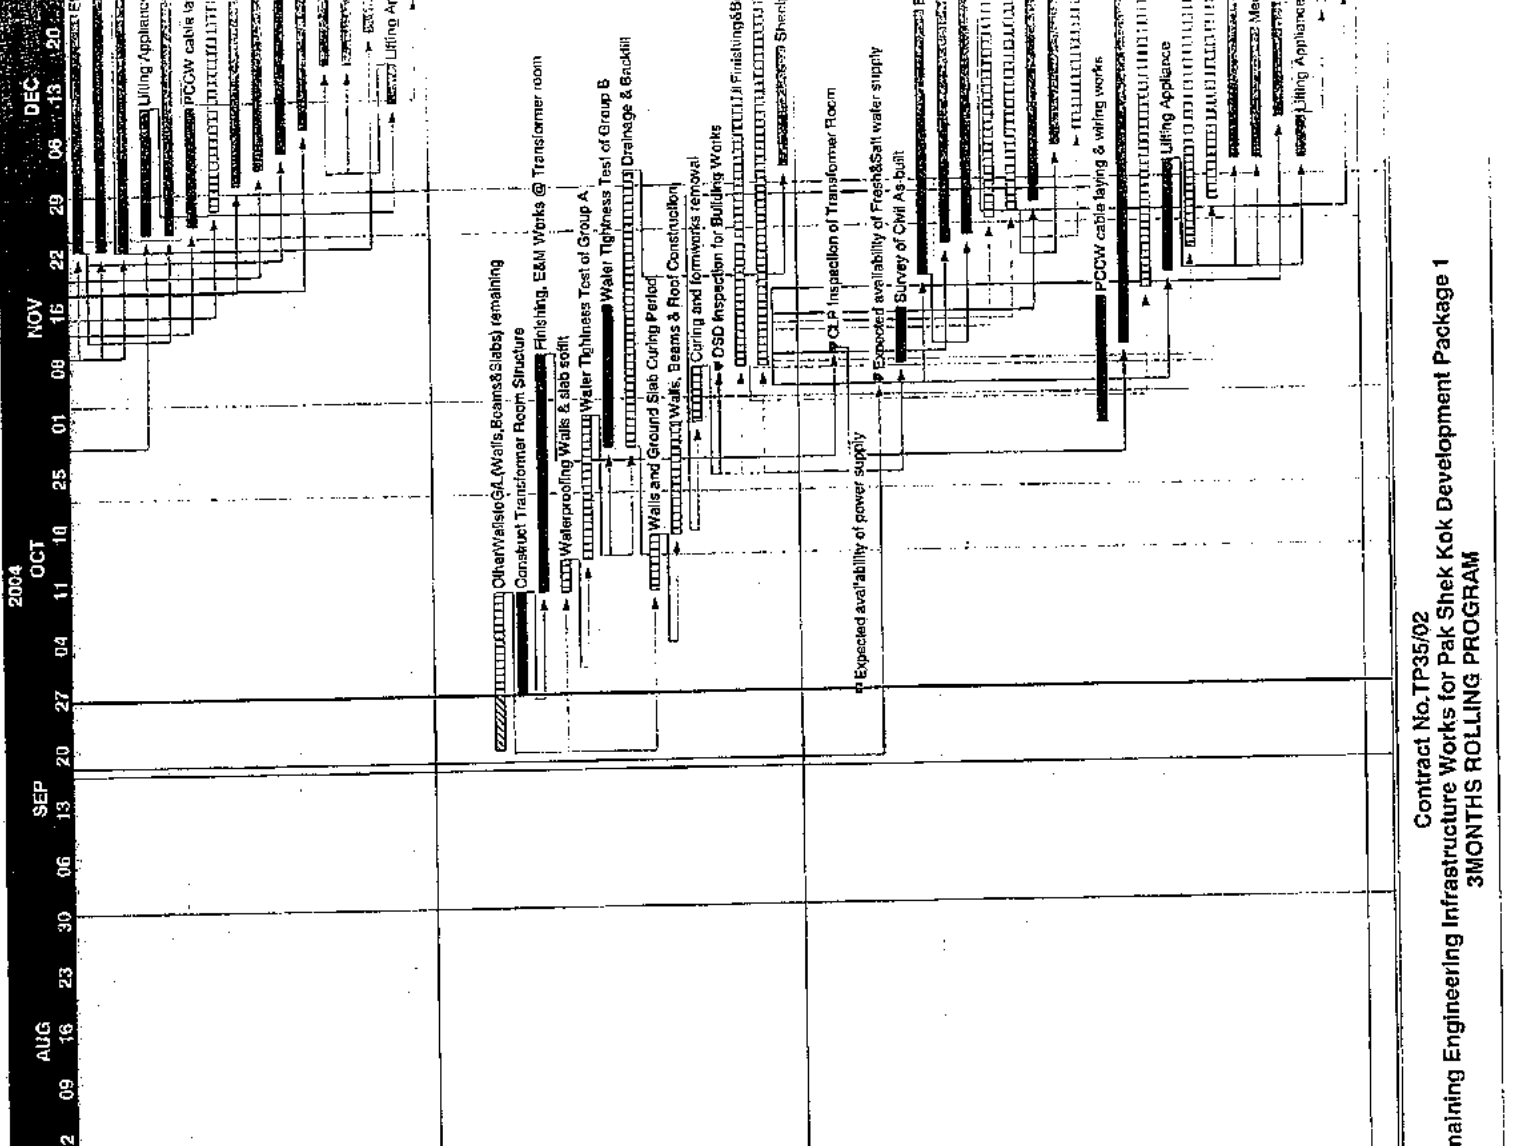

Act ID	Description	Orig Dur	Early Start	Early Finish	Percent Complete
BS-126030	Electrical Installation	30	24NOV04	23DEC04	0
BS-126060	SCADA & PLC Works	35	24NOV04	28DEC04	0
BS-126080	P & D Installation	35	24NOV04	28DEC04	0
BS-126090	Lifting Appliance	14	26NOV04	11DEC04	0
BS-126110	PCCW cable laying & wiring works	15	27NOV04	11DEC04	0
BS-126120	Valves and Pipeworks	40	29NOV04	17JAN05	0
BS-126130	F.S. Services Installation	30	02DEC04	31DEC04	0
BS-126140	Penstock	23	04DEC04	14JAN05	0
BS-126150	Lightning & Earthing Installation	30	08DEC04	04JAN05	0
BS-126160	Deodorizer System	20	09DEC04	04JAN05	0
BS-126170	Sewage Pumpset and VSD	20	17DEC04	05JAN05	0
BS-126180	Mechanical Screen System	30	21DEC04	19JAN05	0
BS-126190	MVAC	5	12DEC04	16DEC04	0
BS-126200	Lifting Appliance testing	5	26DEC04	30DEC04	0
BS-126210	Cabling Works Testing	5	26DEC04	30DEC04	0

Section 13 - Works of Sewage Pumping Station No.2


Remaining Engineering Works

Act ID	Description	Orig Dur	Early Start	Early Finish	Percent Complete
BS-130570	Other Walls (GL Walls, Beams & Slabs) remaining	20	21SEP04	10OCT04	35
BS-130580	Construct Transformer Room Structure	13	28SEP04	10OCT04	0
BS-130590	Finishing, E&M Works @ Transformer room	30	11OCT04	09NOV04	0
BS-130600	Waterproofing Walls & slab soffit	4	11OCT04	14OCT04	0
BS-130610	Water Tightness Test of Group A	18	15OCT04	01NOV04	0
BS-130620	Water Tightness Test of Group B	18	15OCT04	15NOV04	0
BS-130630	Drainage & Backfill	18	25OCT04	17OCT04	0
BS-130640	Walls, Beams & Roof Construction	7	11OCT04	31OCT04	0
BS-130650	Curing and formworks removal	7	01NOV04	07NOV04	0
BS-130660	OSD Inspection for Building Works	35	08NOV04	12DEC04	0
BS-130670	Finishing & Benchmarks for Underground Chambers	60	08NOV04	05JAN05	0
BS-130680	Finishing & Furniture for Above-ground Structure	15	03DEC04	17DEC04	0
BS-130690	Sheepskin Extraction	0	0	0	0
BS-130700	CLP Inspection of Transformer Room	0	10NOV04	0	0
BS-130710	Expected availability of power supply	0	28SEP04	0	0
BS-130720	Expected availability of Fresh & Salt water supply	0	08NOV04	0	0
BS-130730	Expected availability of Fresh & Salt water supply	0	08NOV04	0	0
BS-130740	Survey of Civil As-built	7	08NOV04	14NOV04	0
BS-130750	Electrical Installation - Concealed Conduit	33	18NOV04	12DEC04	0
BS-130760	SCADA and PLC Works	35	23NOV04	27DEC04	0
BS-130770	F.S. Services Installation	30	24NOV04	23DEC04	0
BS-130780	P & D Installation	45	26NOV04	06JAN05	0
BS-130790	Electrical Installation	47	27NOV04	12JAN05	0
BS-130800	MVAC	30	28NOV04	27DEC04	0
BS-130810	Lightning & Earthing Installation	30	05DEC04	03JAN05	0
BS-130820	Cabling Works	30	07DEC04	05JAN05	0
BS-130830	PCCW cable laying & wiring works	19	13OCT04	18NOV04	0
BS-130840	CLP Installation	42	10NOV04	30DEC04	0
BS-130850	Valves & Pipeworks	40	17NOV04	05JAN05	0
BS-130860	Lifting Appliance	14	19NOV04	02DEC04	0
BS-130870	LV Switchboard and Control Panels	30	22NOV04	28DEC04	0
BS-130880	Penstock	40	28NOV04	06JAN05	0
BS-130890	Sewage Pumpset & VSD	20	03DEC04	22DEC04	0
BS-130900	Mechanical Screen System	16	03DEC04	18DEC04	0
BS-130910	Deaerator System	12	08DEC04	21DEC04	0
BS-130920	Lifting Appliance functional testing	5	03DEC04	07DEC04	0
BS-130930	Deaerator System functional testing	6	22DEC04	27DEC04	0
BS-130940	F.S. Services functional testing	3	24DEC04	26DEC04	0


Contract No. TP35/02
 Remaining Engineering Infrastructure Works for Pak Shek Kok Development Package 1
 3 MONTHS ROLLING PROGRAM

Section 15 - Waterworks in Area 15

Act ID	Description	Orig Dur	Early Start	Early Finish	Percent Complete
BS-150100	Electrical Installation	30	24NOV04	23DEC04	0
BS-150110	SCADA & PLC Works	35	24NOV04	28DEC04	0
BS-150120	P & D Installation	35	24NOV04	28DEC04	0
BS-150130	Lifting Appliance	14	26NOV04	11DEC04	0
BS-150140	PCCW cable laying & wiring works	15	27NOV04	11DEC04	0
BS-150150	Valves and Pipeworks	40	29NOV04	17JAN05	0
BS-150160	F.S. Services Installation	30	02DEC04	31DEC04	0
BS-150170	Penstock	23	04DEC04	14JAN05	0
BS-150180	Lightning & Earthing Installation	30	08DEC04	04JAN05	0
BS-150190	Deodorizer System	20	09DEC04	04JAN05	0
BS-150200	Sewage Pumpset and VSD	20	17DEC04	05JAN05	0
BS-150210	Mechanical Screen System	30	21DEC04	19JAN05	0
BS-150220	MVAC	5	12DEC04	16DEC04	0
BS-150230	Lifting Appliance testing	5	26DEC04	30DEC04	0
BS-150240	Cabling Works Testing	5	26DEC04	30DEC04	0

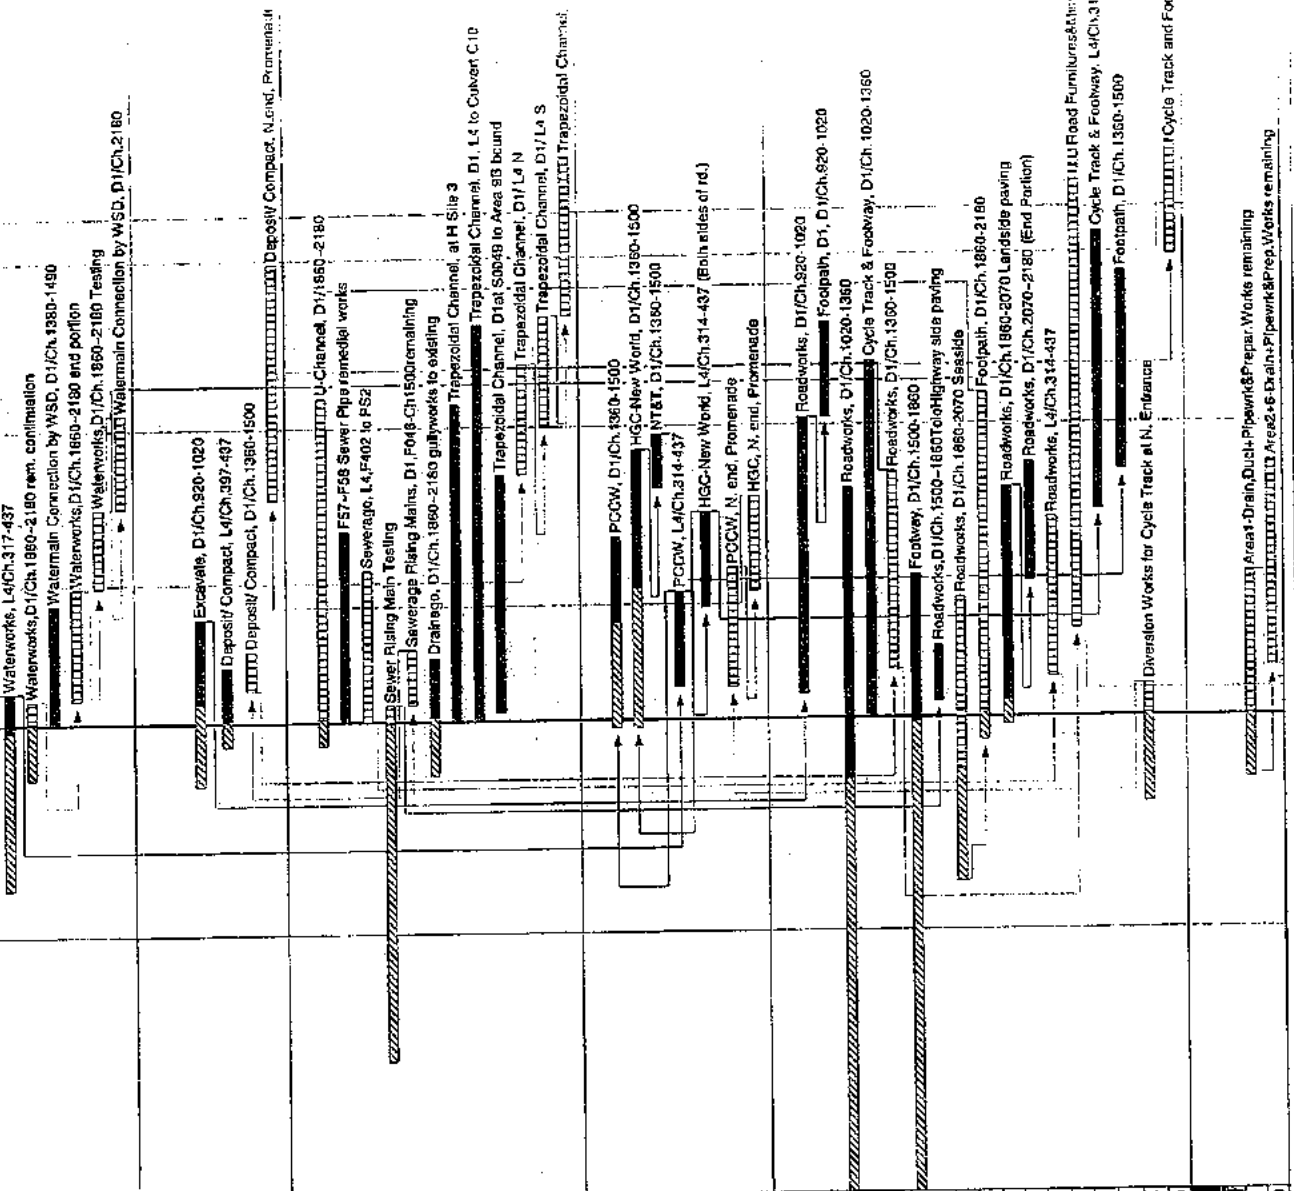

Act ID	Description	Orig Dur	Early Start	Early Finish	Percent Complete
Section 16 - Remainder of Works, except LS+EW					
Part 16.1 Waterworks Section 16					
B4-1695D7	Waterworks, L4/Ch.317-437	20	07SEP04 A	01OCT04	80
B4-1695D8	Waterworks, D1/Ch.1860-2180 rem. continuation	12	12SEP04 A	30SEP04	72
B4-1695D9	Watermain Connection by WSD, D1/Ch.1380-1490	15	28SEP04	12OCT04	0
B4-1695D10	Waterworks, D1/Ch.1660-2180 end portion	14	01OCT04	14OCT04	0
B4-1695D11	Waterworks, D1/Ch.1860-2180 Testing	10	15OCT04	24OCT04	0
B4-1695D12	Watermain Connection by WSD, D1/Ch.2180	12	25OCT04	06NOV04	0
Part 16.2 Drainage & Sewerage Section 16					
B3-1622M1	Excavate, D1/Ch.920-1020	25	20SEP04 A	10OCT04	50
B3-1622M2	Deposit/ Compact, L4/Ch.397-437	10	25SEP04 A	04OCT04	33
B3-1622M3	Deposit/ Compact, D1/Ch.1360-1500	5	02OCT04	06OCT04	0
B3-1622M4	Deposit/ Compact, N end, Promenade	30	26OCT04	24NOV04	0
Part 16.3 Roadworks Section 16					
B4-1693B56	U-Channel, D1/1860-2180	45	25SEP04 A	07NOV04	0
B4-1693B57	F57-F58 Sewer Pipe remedial works	24	28SEP04	21OCT04	0
B4-1693B58	Sewerage, L4, F402 to F52	19	28SEP04	16OCT04	0
B4-1693B59	Sewer Rising Main Testing	45	16AUG04 A	28SEP04	85
B4-1693B60	Sewerage Rising Mains, D1, F016-Ch1500remaining	7	30SEP04	08OCT04	0
B4-1693B61	Drainage, D1/Ch.1860-2180 gullyworks to existing	15	21SEP04 A	05NOV04	50
B4-1693B62	Trapezoidal Channel, at H Site 3	40	28SEP04	06NOV04	0
B4-1693B63	Trapezoidal Channel, D1, L4 to Culvert C10	50	28SEP04	16NOV04	0
B4-1693B64	Trapezoidal Channel, D1at S0049 to Area 9B bound	30	28SEP04	28OCT04	0
B4-1693B65	Trapezoidal Channel, D1/L4 N	14	28OCT04	11NOV04	0
B4-1693B66	Trapezoidal Channel, D1/L4 S	14	04NOV04	17NOV04	0
B4-1693B67	Trapezoidal Channel, L4	20	16NOV04	07DEC04	0
Part 16.4 Footpaths Section 16					
UT-1600T3A	PCGW, D1/Ch.1360-1500	15	27SEP04 A	20OCT04	55
UT-1600T3B	HGC-New World, D1/Ch.1360-1500	15	27SEP04 A	31OCT04	50
UT-1600T3C	NT&T, D1/Ch.1360-1500	7	27OCT04	02NOV04	0
UT-1600T3D	PCGW, L4/Ch.314-437	12	03OCT04	13OCT04	0
UT-1600T3E	HGC-New World, L4/Ch.314-437 (Both sides of rd.)	12	16OCT04	23OCT04	0
UT-1600T3F	PCGW, N. end, Promenade	15	02OCT04	16OCT04	0
UT-1600T3G	HGC, N. end, Promenade	12	14OCT04	25OCT04	0
Part 16.5 Roadworks Section 16					
B5-1670A1	Roadworks, D1/Ch.920-1020	35	01OCT04	04NOV04	0
B5-1670A2	Footpath, D1, D1/Ch.920-1020	12	05NOV04	16NOV04	0
B5-1670A3	Roadworks, D1/Ch.1020-1360	75	22JUL04 A	25OCT04	82
B5-1670A4	Cycle Track & Footway, D1/Ch.1020-1360	45	28SEP04	11NOV04	0
B5-1670A5	Footway, D1/Ch.1500-1660	25	04OCT04	28OCT04	0
B5-1670A6	Roadworks, D1/Ch.1360-1500	90	15JUL04 A	15OCT04	80
B5-1670A7	Roadworks, D1/Ch.1500-1660	7	30SEP04	06OCT04	0
B5-1670A8	Roadworks, D1/Ch.1660-2070 Sea-side	25	07SEP04 A	12OCT04	40
B5-1670A9	Footpath, D1/Ch.1860-2180	45	25SEP04 A	07NOV04	8
B5-1670A10	Roadworks, D1/Ch.1860-2070 Landside paving	20	27SEP04 A	26OCT04	10
B5-1670A11	Roadworks, D1/Ch.2070-2180 (End Portion)	15	15OCT04	23OCT04	0
B5-1670A12	Roadworks, L4/Ch.314-437	60	09OCT04	07DEC04	0
B5-1670A13	Road Furniture&Misc, D1/Ch.920-1020	35	24OCT04	27NOV04	0
B5-1670A14	Cycle Track & Footway, L4/Ch.314-437	15	28OCT04	01OCT04	75
B5-1670A15	Footpath, D1/Ch.1360-1500	24	17SEP04 A	01OCT04	0
B5-1670A16	Overturn Works for Cycle Track at N. Entrance	14	28NOV04	08DEC04	0
Section 17 - Areas 1,2,6,7A,7B Landscape Softwork					
Part 17.1 Landscape Works Section 17					
BL-1705A11	Area 1-Drain, Duct,Pipe&Prep, Works remaining	26	20SEP04 A	15OCT04	31
BL-1705A12	Area 2-6-Drain,Pipe&Prep, Works remaining	26	04OCT04	29OCT04	0

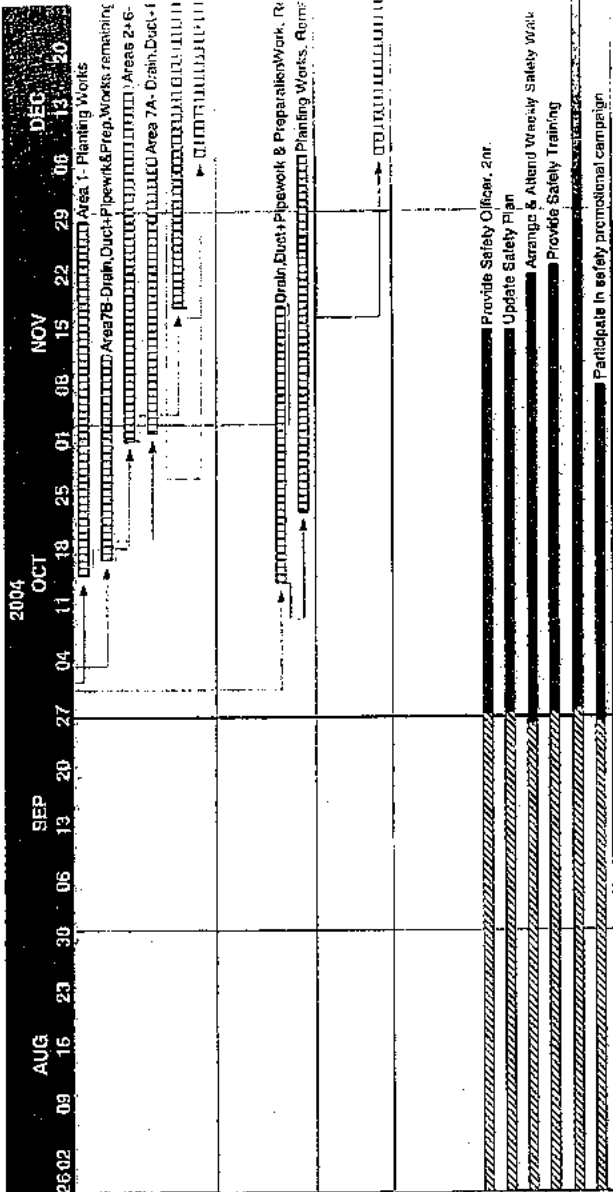

Act. ID	Description	Orig Dur	Early Start	Early Finish	Percent Complete
BL-1707A1	Area 1- Planting Works	45	16OCT04	28NOV04	0
BL-1705A14	Area 7B- Drain, Duct+ Pipe work & Prep. Works remaining	26	18OCT04	12NOV04	0
BL-1707A2	Area 2-6- Planting Works	45	02NOV04	19DEC04	0
BL-1705A3	Area 7A- Drain, Duct+ Pipe work & Preparation Works	35	03NOV04	07DEC04	0
BL-1707A4	Area 7B- Planting Works	45	18NOV04	02JAN05	0
BL-1707A3	Area 7A- Planting Works	45	08DEC04	21JAN05	0
Section 18- Remainder of Landscaping Works					
Part 17- Landscaping Works - Section 18					
BL-1814A1	Drain, Duct+ Pipe work & Preparation Work, Remainder	35	15OCT04	18NOV04	0
BL-1814A2	Planting Works, Remainder	45	24OCT04	07DEC04	0
Section 20- Remainder of Establishment Works					
Part 17- Landscaping Works - Section 20					
BL-300001	Establishment Works - Remainder	385	18DEC04	07DEC05	0
Part 14 Site Safety					
BT-1401DD	Provide Safety Officer, 2nr.	810	27AUG02 A	15NOV04	94
BT-1401CO	Update Safety Plan	810	31AUG02 A	13NOV04	94
BT-1401GO	Arrange & Attend Weekly Safety Walk	805	03SEP02 A	22NOV04	93
BT-1401HO	Provide Safety Training	810	10SEP02 A	28NOV04	93
BT-1401EO	Attend Site Safety Committee & Mgmt. Committee	810	26OCT02 A	02JAN05	68
BT-1401KO	Participate in safety promotional campaign	594	28NOV02 A	08NOV04	94


Contract No. TP 35/02
 Remaining Engineering Infrastructures Works for Pak Shek Kok Development Package 1
 3 MONTHS ROLLING PROGRAM

Date	28SEP04	Early bar
Page number	5A	Progress bar
Page count	8A	Critical bar
Number/Version	TP3502/360 N/25	Summary bar
Company name	Prinavera Ocean Construction Co. Ltd.	Start milestone point
	Prinavera Systems, Inc.	Finish milestone point




Appendix G

Construction Site Area

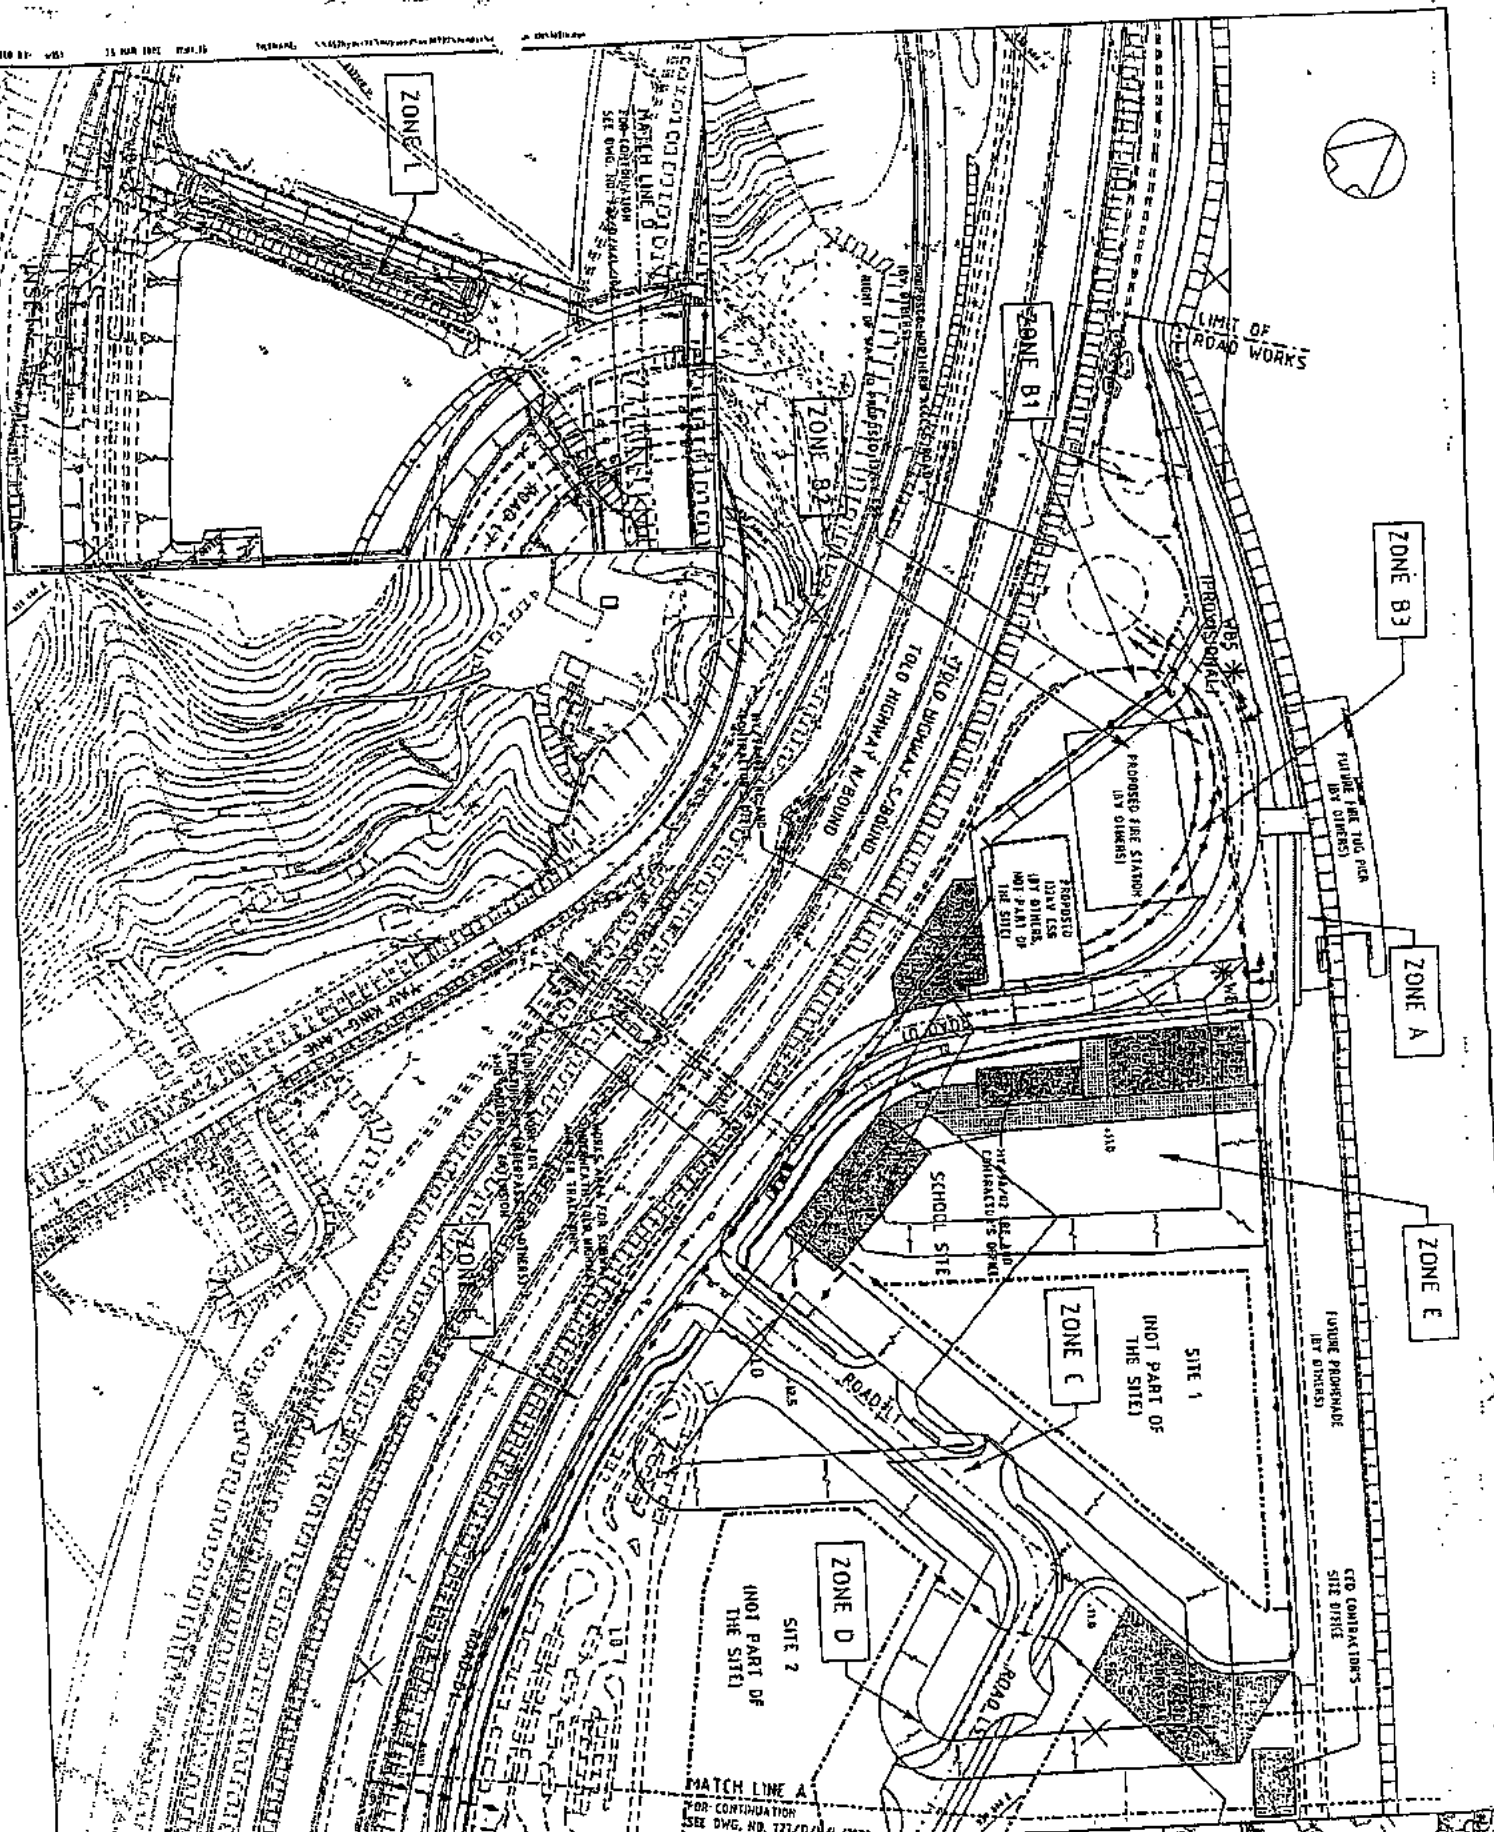

MATCH LINE A
FOR CONTINUATION
SEE DWG. NO. 727/D/H/L/1021

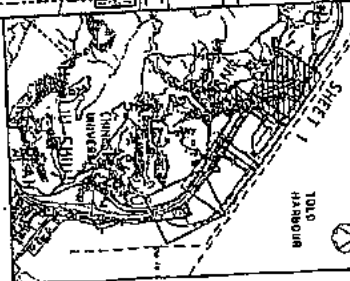

- LEGEND:
- BOUNDARY LINE BETWEEN AREAS
 - * M/B1 PROPOSED WHARF MASSING DAY NO. 1

NO.	DESCRIPTION	DATE	BY	CHECKED	APPROVED
1	PRELIMINARY DESIGN	1981			
2	REVISION	1981			
3	REVISION	1981			
4	REVISION	1981			
5	REVISION	1981			
6	REVISION	1981			
7	REVISION	1981			
8	REVISION	1981			
9	REVISION	1981			
10	REVISION	1981			

REPAIRING ENGINEERING INFRASTRUCTURE WORKS FOR P&S CHUK BOX DEVELOPMENT PACKAGE 1



CONTRACT NO. TP 35/02

Hyder
Consulting

AREA OF SITE POSSESSION

TENDER DRAWING

727/D/H/L/1021

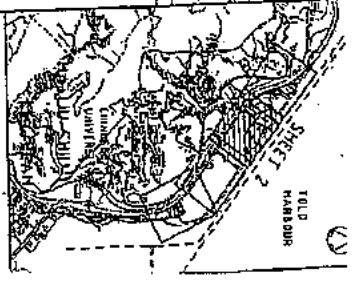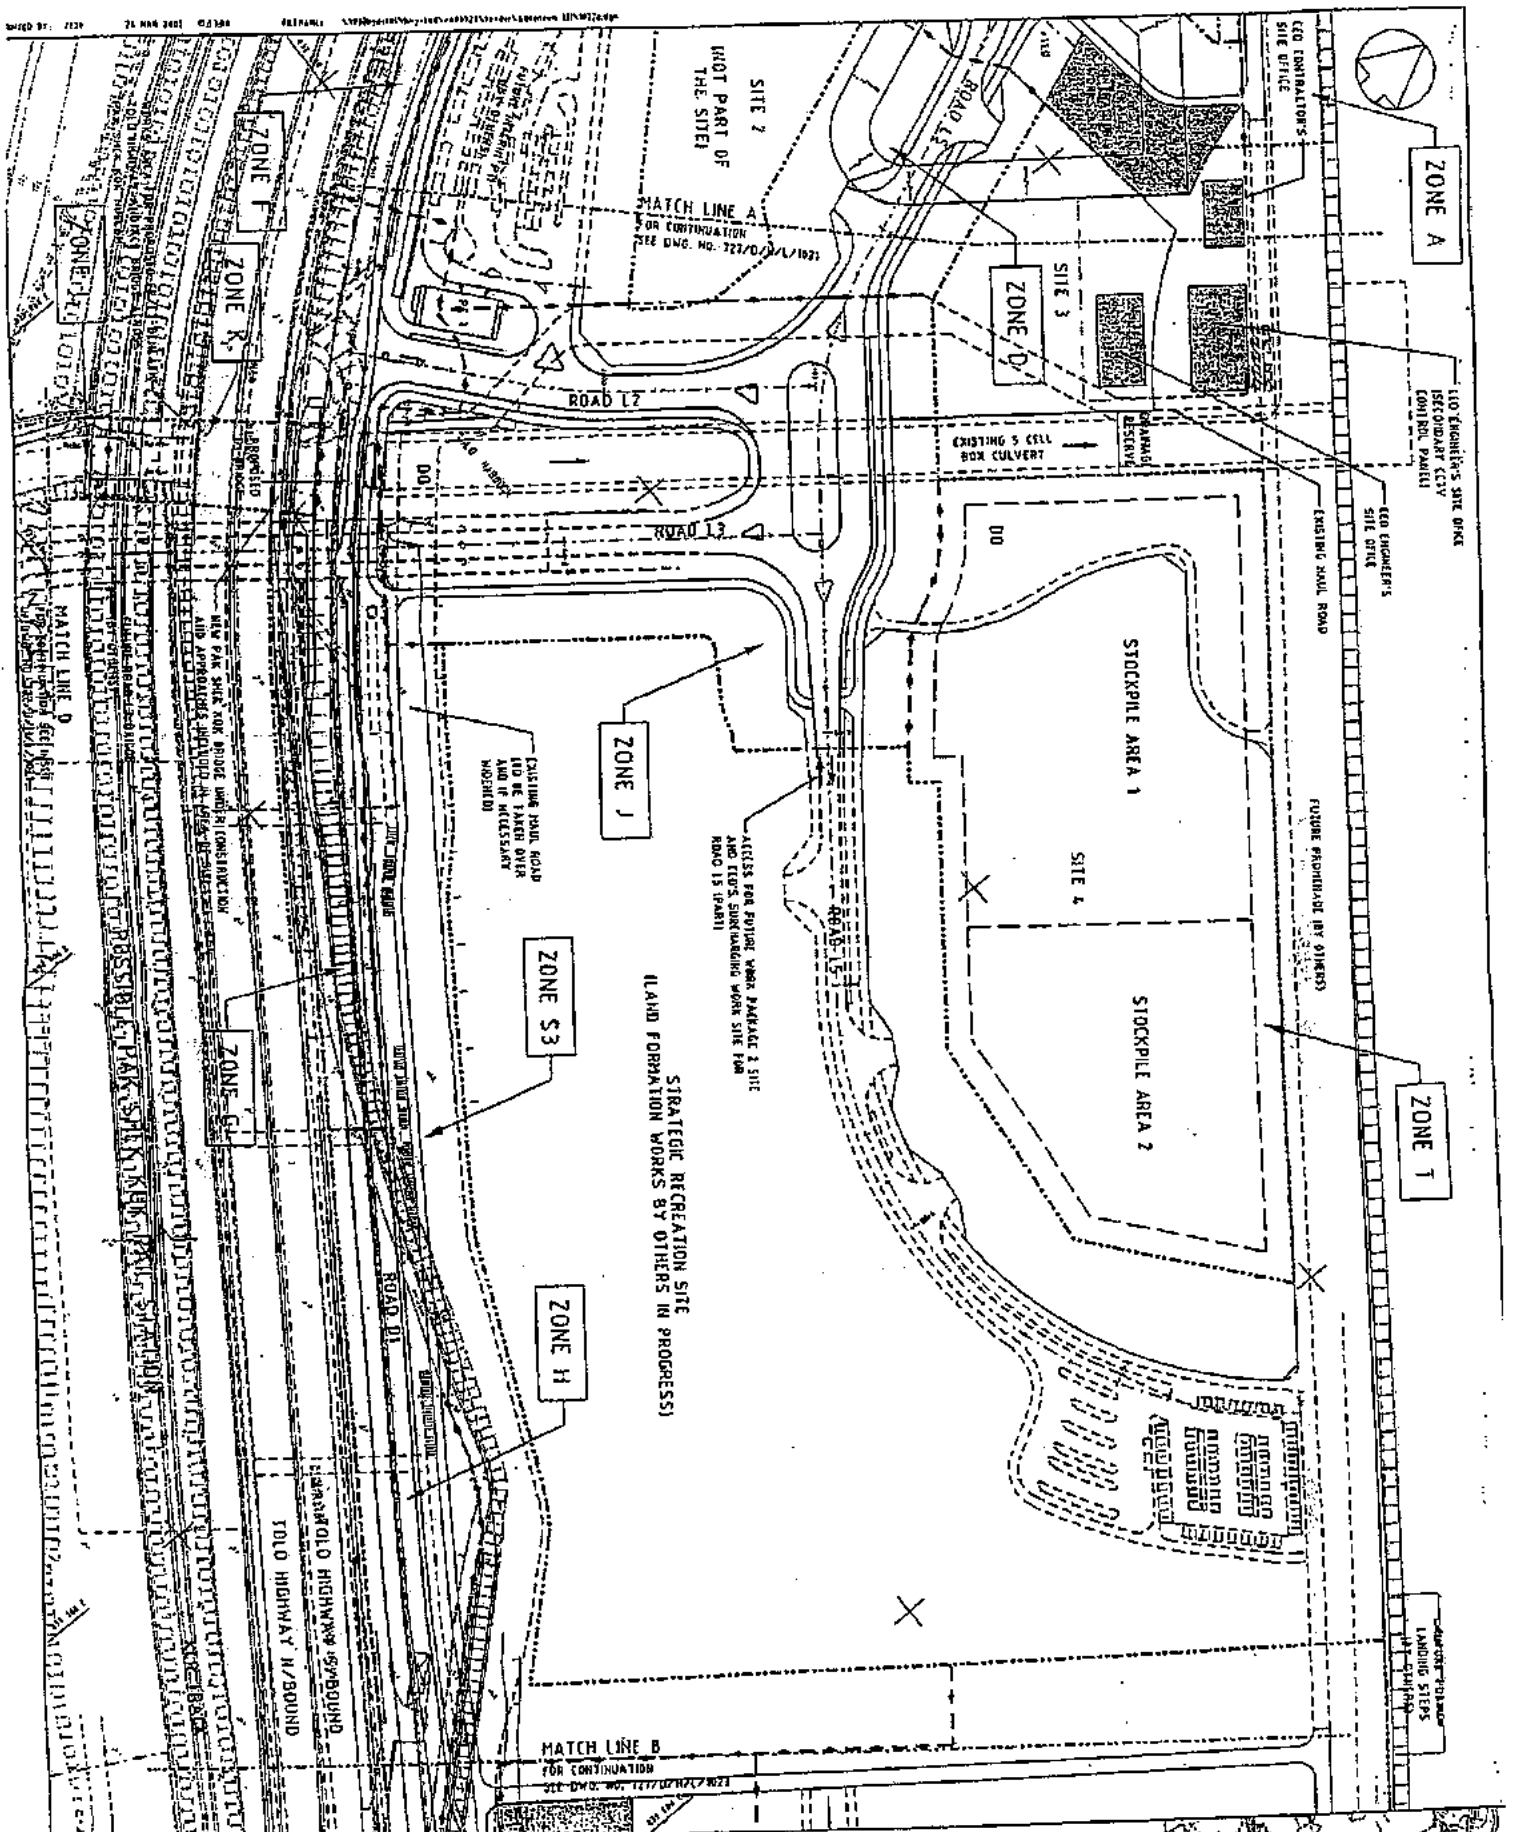


NOTES:
 FOR LEGEND SEE DRAWING NO. 722/D/H/V/1023

NO.	DESCRIPTION	DATE	BY	CHKD.
1	ISSUED FOR TENDER	21/11/2023		
2	REVISION	21/11/2023		
3	REVISION	21/11/2023		
4	REVISION	21/11/2023		
5	REVISION	21/11/2023		
6	REVISION	21/11/2023		
7	REVISION	21/11/2023		
8	REVISION	21/11/2023		
9	REVISION	21/11/2023		
10	REVISION	21/11/2023		

CONTRACT NO. TP 35/02
Hyster
Area of Site Possession

TENDER DRAWING
722/D/H/V/1022



EXISTING PARKING LANDSCAPING

PROPOSED QUIET-AIR

3' WIDE PROPOSED (BY OTHERS)

PROPOSED MITERAIL

ZONE N2

ZONE M1

ZONE M

SCIENTIFIC PARK PHASES 2 AND 3 SITE (LAND FORMATION WORKS BY OTHERS IN PROGRESS)

APPROX. FOR FUTURE WORK PARKING SITE AND LOTS FOR USE FOR SUTURE DEVELOPMENT OF ROAD 4 & PARALLEL

ZONE S2

ZONE ST

EXISTING MAIN ROAD TO BE TAKEN OVER AND IF NECESSARY (WORKING)

MAIN ROUTE OF SCIENTIFIC PARK CONTRACTOR

1:800

PROPOSED BOX CUT VERY C10

ZONE R


MATCH LINE C FOR CONTINUATION SEE DWG. NO. 727/D/H/L/1023

MATCH LINE B FOR CONTINUATION SEE DWG. NO. 727/D/H/L/1023

ZONE H

ZONE P

1000 HIGHWAY - 1/20000

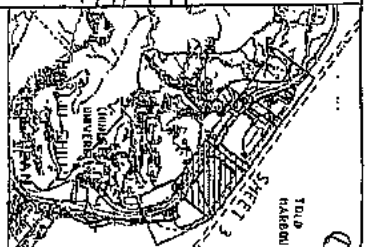

NOTES:
FOR LEGEND, SEE DRAWING NO. 727/D/H/L/1023

TITLE
DATE
SCALE

NO.	DESCRIPTION	DATE	BY	CHECKED
1	PRELIMINARY	2017/03/27		
2	FINAL	2017/03/27		

DATE	2017/03/27	BY	[Signature]	CHECKED	[Signature]
SCALE	AS SHOWN	TITLE	TENDER DRAWING	DATE	2017/03/27

RICHMOND ENGINEERING INFRASTRUCTURE FOR PARK SITE DEVELOPMENT PACKAGE 1


CONTRACT NO. TP 35/0:

Hyder Consulting

AREA OF SITE POSSESSION

TENDER DRAWING

727/D/H/L/1023

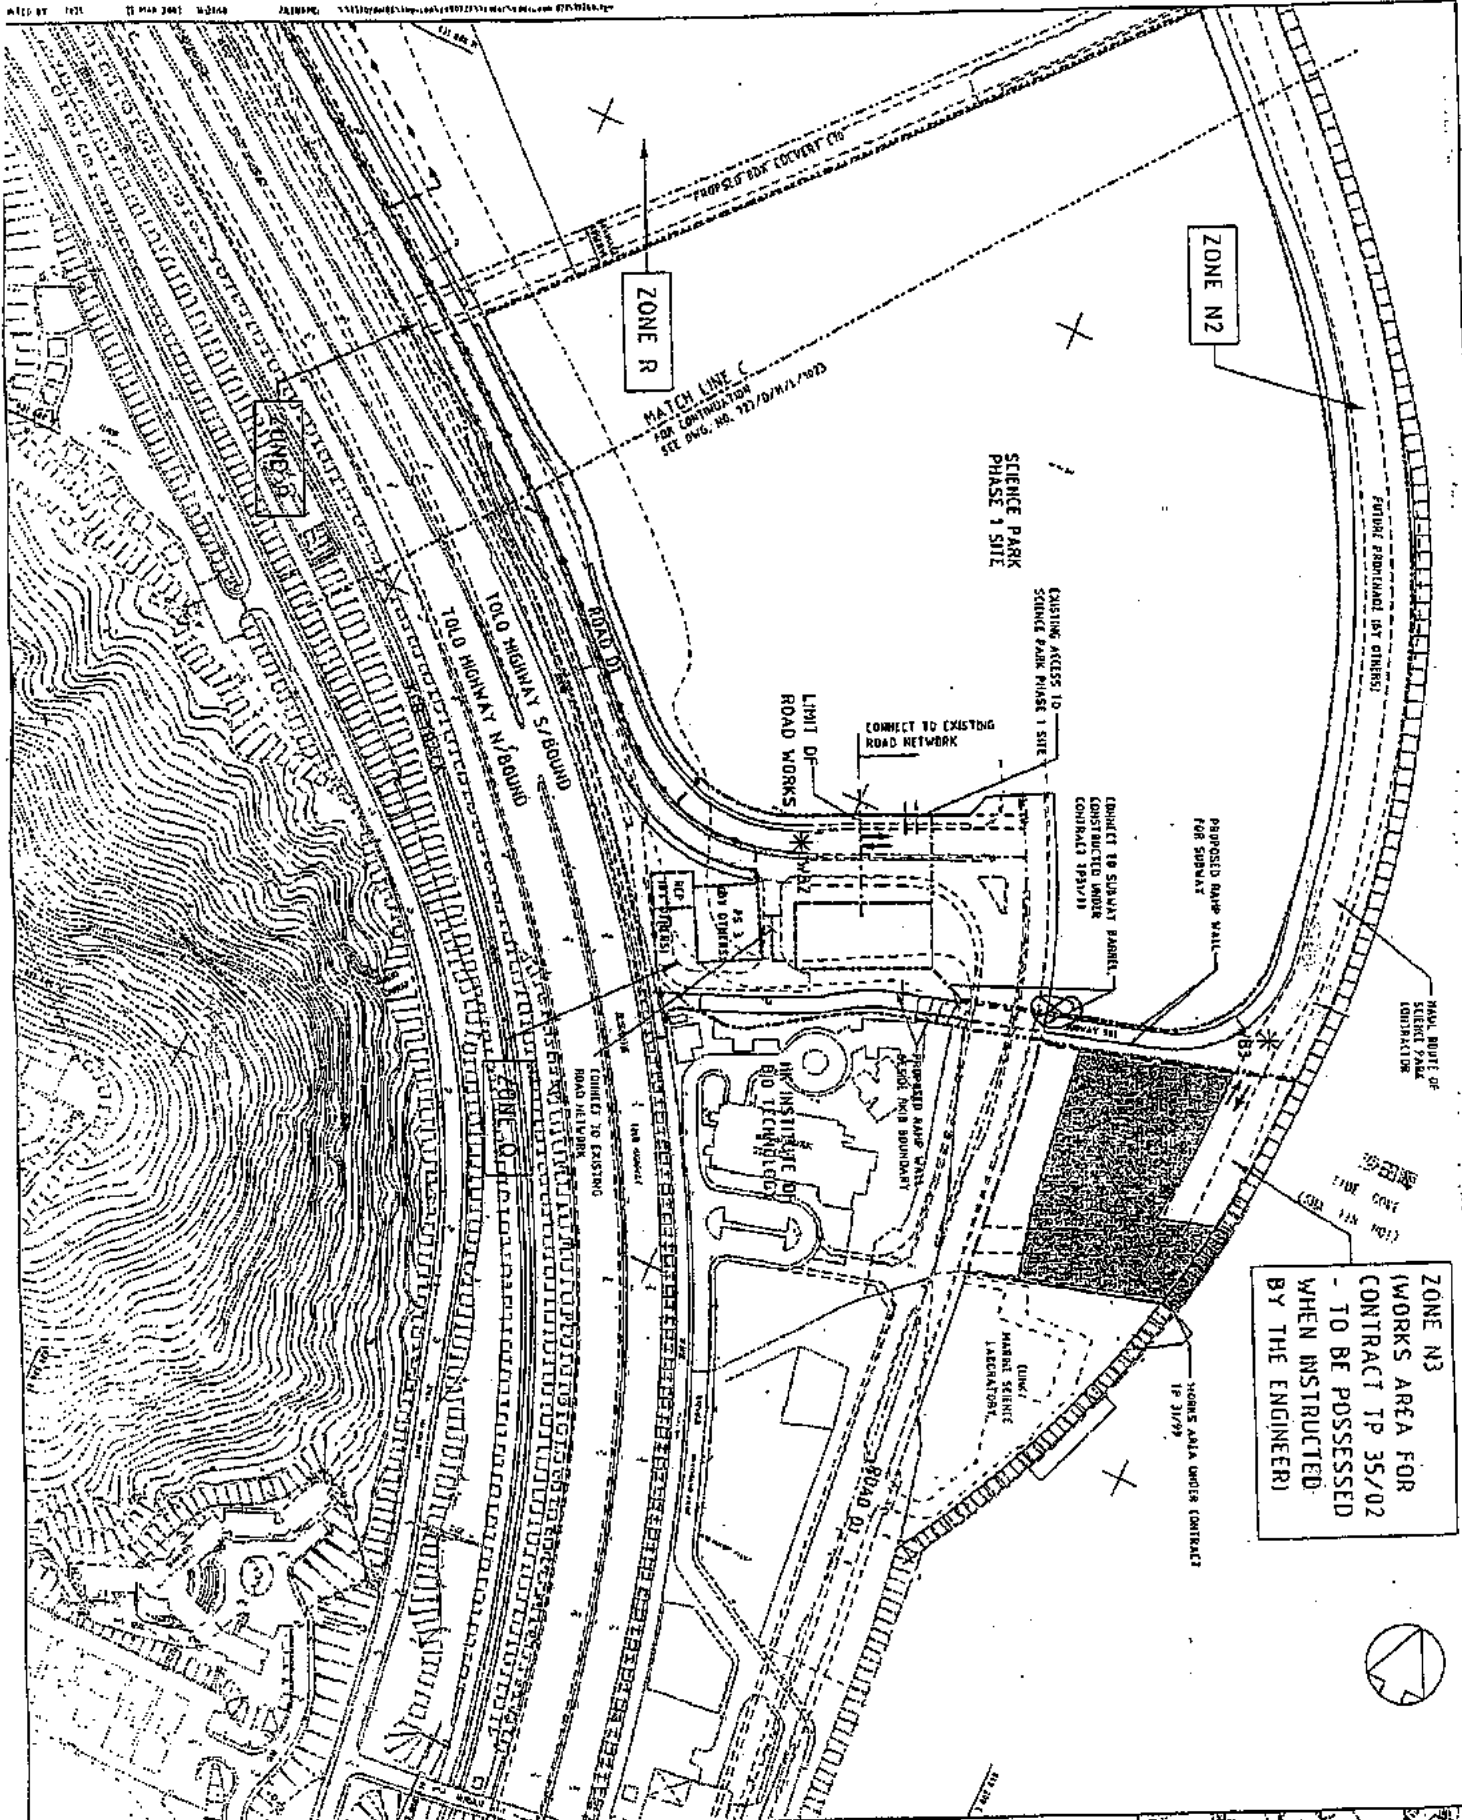

ZONE N3
 (WORKS AREA FOR
 CONTRACT IP 35/02
 - TO BE POSSESSED
 WHEN INSTRUCTED
 BY THE ENGINEER)

ZONE R

ZONE N2

**SCIENCE PARK
 PHASE 1 SITE**

MATCH LINE C
 FOR CONTINUATION
 SEE DWG. NO. 727/D/H/1/1073

1000 HIGHWAY S BOUND
 1000 HIGHWAY N BOUND
 1000 HIGHWAY E BOUND

LIMIT OF
 ROAD WORKS

CONNECT TO EXISTING
 ROAD NETWORK

EXISTING ACCESS TO
 SCIENCE PARK PHASE 1 SITE

CONDUCT TO SUBWAY RAMP
 CONSTRUCTED UNDER
 CONTRACT IP35/02

PROPOSED RAMP WALL
 FOR SUBWAY

MAIN ROUTE OF
 SUBWAY
 CONSTRUCTION

WORKS AREA UNDER CONTRACT
 IP 35/02

LIMIT
 MARKET SCIENCE
 LABORATORY

PROPOSED RAMP WALL
 AND RAMP BOUNDARY

MR. INSTITUTE OF
 BIO-TECHNOLOGY



NOTES :
 FOR LEGEND SEE DRAWING NO.
 727/D/H/1/1071



AREA OF SITE - POSSESSION

TENDER DRAWING

727/D/H/1/1074

CONTRACT NO. IP 35/02

Hyder Consulting

NO.	REVISION	DATE
1	ISSUED FOR TENDER	15/08/02
2	REVISED FOR TENDER	21/11/02
3	REVISED FOR TENDER	15/01/03
4	REVISED FOR TENDER	15/01/03

Factory Development Department, U.S.S.R.

REMAINING ENGINEERING WORKS FOR PAK SILEX FOR DEVELOPMENT PARADISE 1



Appendix H

**The Summary of Implementation Status
of
Mitigation Measures during Weekly Site Inspections**



The Summary of Implementation status of Mitigation Measures

Aspect	Mitigation Measures	Implementation Status		
		Y	N	N/A
Air	- The height from which fill materials were dropped was controlled to a practical height to minimize the fugitive dust arising from unloading.	✓		
	- During transportation by truck, material was loaded to a level higher than the side and tail boards, and should be dampened or covered before transport.	✓		
	- All stockpile of aggregate or spoil were enclosed or covered and water applied in dry or windy condition.		✓	
	- Effective water sprays were used on the site at potential dust emission sources such as unpaved area.		✓	
	- The haul road was either paved or regular watering.	✓		
	- Vehicle speed was limited to 20 km/hr.	✓		
	- Adequately designed wheel washing facilities including a high pressure water jet were provided at all main entrance of work site.	✓		
Noise	- Only well maintained plant was operated on-site and plant should be serviced regularly during the construction works.	✓		
	- Machines and plants that were in intermittent use were shut down between work periods or throttled down to a minimum.	✓		
	- Plant known to emit noise strongly in one direction, where possible, were orientated so that the noise is directed away from nearby NSRs.	✓		
	- Silencers or mufflers on construction equipment were considered.	✓		
Water	- Recirculation system was used to reduce SS from the vehicle wheel washing facility.	✓		
	- Fuel tanks on site were housed within drainable trays and regularly drained of rainwater.	✓		
	- Washing area and road exiting were paved from washing facility.	✓		
	- Permanent / Temporary ditches were provided to facilities run-off discharge into the appropriate watercourses, via a sediment trap/sediment retention basin, prior to discharge.	✓		
	- Sedimentation tanks with adequate capacity to settle the sand and silt out were provided.	✓		
	- Sedimentation tanks were regularly cleaned and maintained in order to control their efficiency and to prevent the recycled water overflow to drains.	✓		
	- All drainage facilities were adequate for the controlled release of storm flows.	✓		
	- Exposed soil areas were minimized to reduce the potential for increased siltation and contamination of run-off.	✓		
	- All chemical stores were contained (bundled) such that spills are not allowed to gain access to water bodies.	✓		
	- Chemical toilets were provided to handle the sewage from the on-site construction workforce.	✓		



The Summary of Implementation status of Mitigation Measures

Aspect	Mitigation Measures	Implementation Status		
		Y	N	N/A
Waste	- Wastes were handle and store in a manner, which ensure that they were held securely without loss or leakage, thereby minimizing the potential for pollution.	√		
	- Authorized or licensed waste hauliers were use to collect the specific category of waste.	√		
	- Wastes were removed in a timely manner.	√		
	- The waste storage areas were maintained and cleaned regularly.	√		
	- Windblown litter and dust during transportation by either covering trucks or transporting wastes in enclosed containers were minimized.	√		
	- Waste disposal permits were obtained form the appropriate authorities.	√		
	- Wastes were disposed at licensed sites.	√		
	- Procedures such as a ticketing system were developed to facilitate tracing of loads, particularly for chemical waste, and to ensure that illegal disposal of wastes does not occur.	√		
	- Records of the quantities of wastes generated, recycled and disposal were maintained.	√		
Chemical Waste	- Under the Waste Disposal (Chemical Waste) (General) Regulation, chemical waste producers were registered with EPD.	√		
	- Chemical wastes were transported by a registered chemical waste collector to a facility licensed to receive chemical waste.	√		
	- Containers used for the storage of chemical wastes were:			
	1.Suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed;	√		
	2.Enclosed on at least 3 sides;	√		
	3.Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest;	√		
	4.-Have adequate ventilation;	√		
	5.Covered to prevent rainfall entering (water collected within the bund must be tested and disposal as chemical waste if necessary);	√		
6.Arranged so that incompatible materials are adequately separated.	√			



Appendix I
IEC and RE Comments on Monthly EM&A Report
—
September 2004



IEC and RE Comments on Monthly Environmental Monitoring and Audit Report – September 2004

Item No.	Document Reference	Comment	ET Response
1	ES and 8.1	Please specify the observations in the table are raised by IEC during the monthly site inspection.	Item 3, 4 and 5 shown in the ES and Table 8.1 were raised by IEC during the monthly site inspection.
2	2.1, Table 2.1 and Appendix A	Please update the name of the project proponent, "Civil Engineering and Development Department, CEDD"	The name of the project proponent, "Civil Engineering and Development Department, CEDD" had been updated. (Section 2.1, Table 2.1 and Appendix A)
3	2.3	The programme showing in Appendix F starts from August to December 2004.	The first sentence – "Details of construction programme (from June to September 2004) are shown in Appendix F" shown in the Section 2.3 is incorrect. The sentence should be "from August to December 2004".
4	6.1 and 6.3	The name of the licence is not consistent. Please check and amend.	After checking, the first sentence – "Under the Wastewater Discharge Licence (No.: 2946), the discharge limit of Suspended Solids content of the effluent at this site should be 30mg/L." should be amended as "the Discharge of Industrial Trade Effluent Licence (Licence No.: 2946)".



Appendix J

Wastewater Monitoring

Test Report of Wastewater Samples from Discharge Points



東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

8/F, Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com



TEST REPORT

Form : E/EN/R/01/Issue 4 (1/1) [08/02]

Environmental Testing of Water & Wastewater

Report No. : ENA40412
Date of issue : 13 September 2004
Page No. : 1 of 1

Information provided by client

Client name : Penta - Ocean Construction Co Ltd
Client address : 30/F MLC Tower 248 Queen's Road East Wan Chai HK
Sample Source : Remaining Engineering Infrastructure Works for Pak Shek Kok Development, Package 1 (Contract No. TP35/02)
Sample Type : Wastewater
Date of sampling : 9 September 2004
Sample Description : The sample was collected in 500mL plastic bottle and chilled when received.

Laboratory information

Date Received : 9 September 2004

Result

Client Sample ID	Lab Ref No	Test	Method Used	Result	Expanded Uncertainty*	Date Tested
Sample 1 (Discharge Point at PS1)	W17299 (01)	Total Suspended Solids	In house method TPE/006/W	<5.0 mg/L	N/A	10 September 2004

Remark (if any) : * All uncertainty was calculated at 95% confidence level and sampling uncertainty is not included. Coverage factor is 2.0 (assume that effective degree of freedom is infinity).

Checked by : Linda Law
Linda Law
Chemist


Approved by : C L Lau
C L Lau
Chief Chemist

TPE/001/W

Hong Kong Accreditation Service (HKAS) has accredited this laboratory under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS Directory of Accredited Laboratories. The results shown in this report were determined by this laboratory in accordance with its terms of accreditation. This report shall not be reproduced unless with prior written approval from this laboratory.



Figures

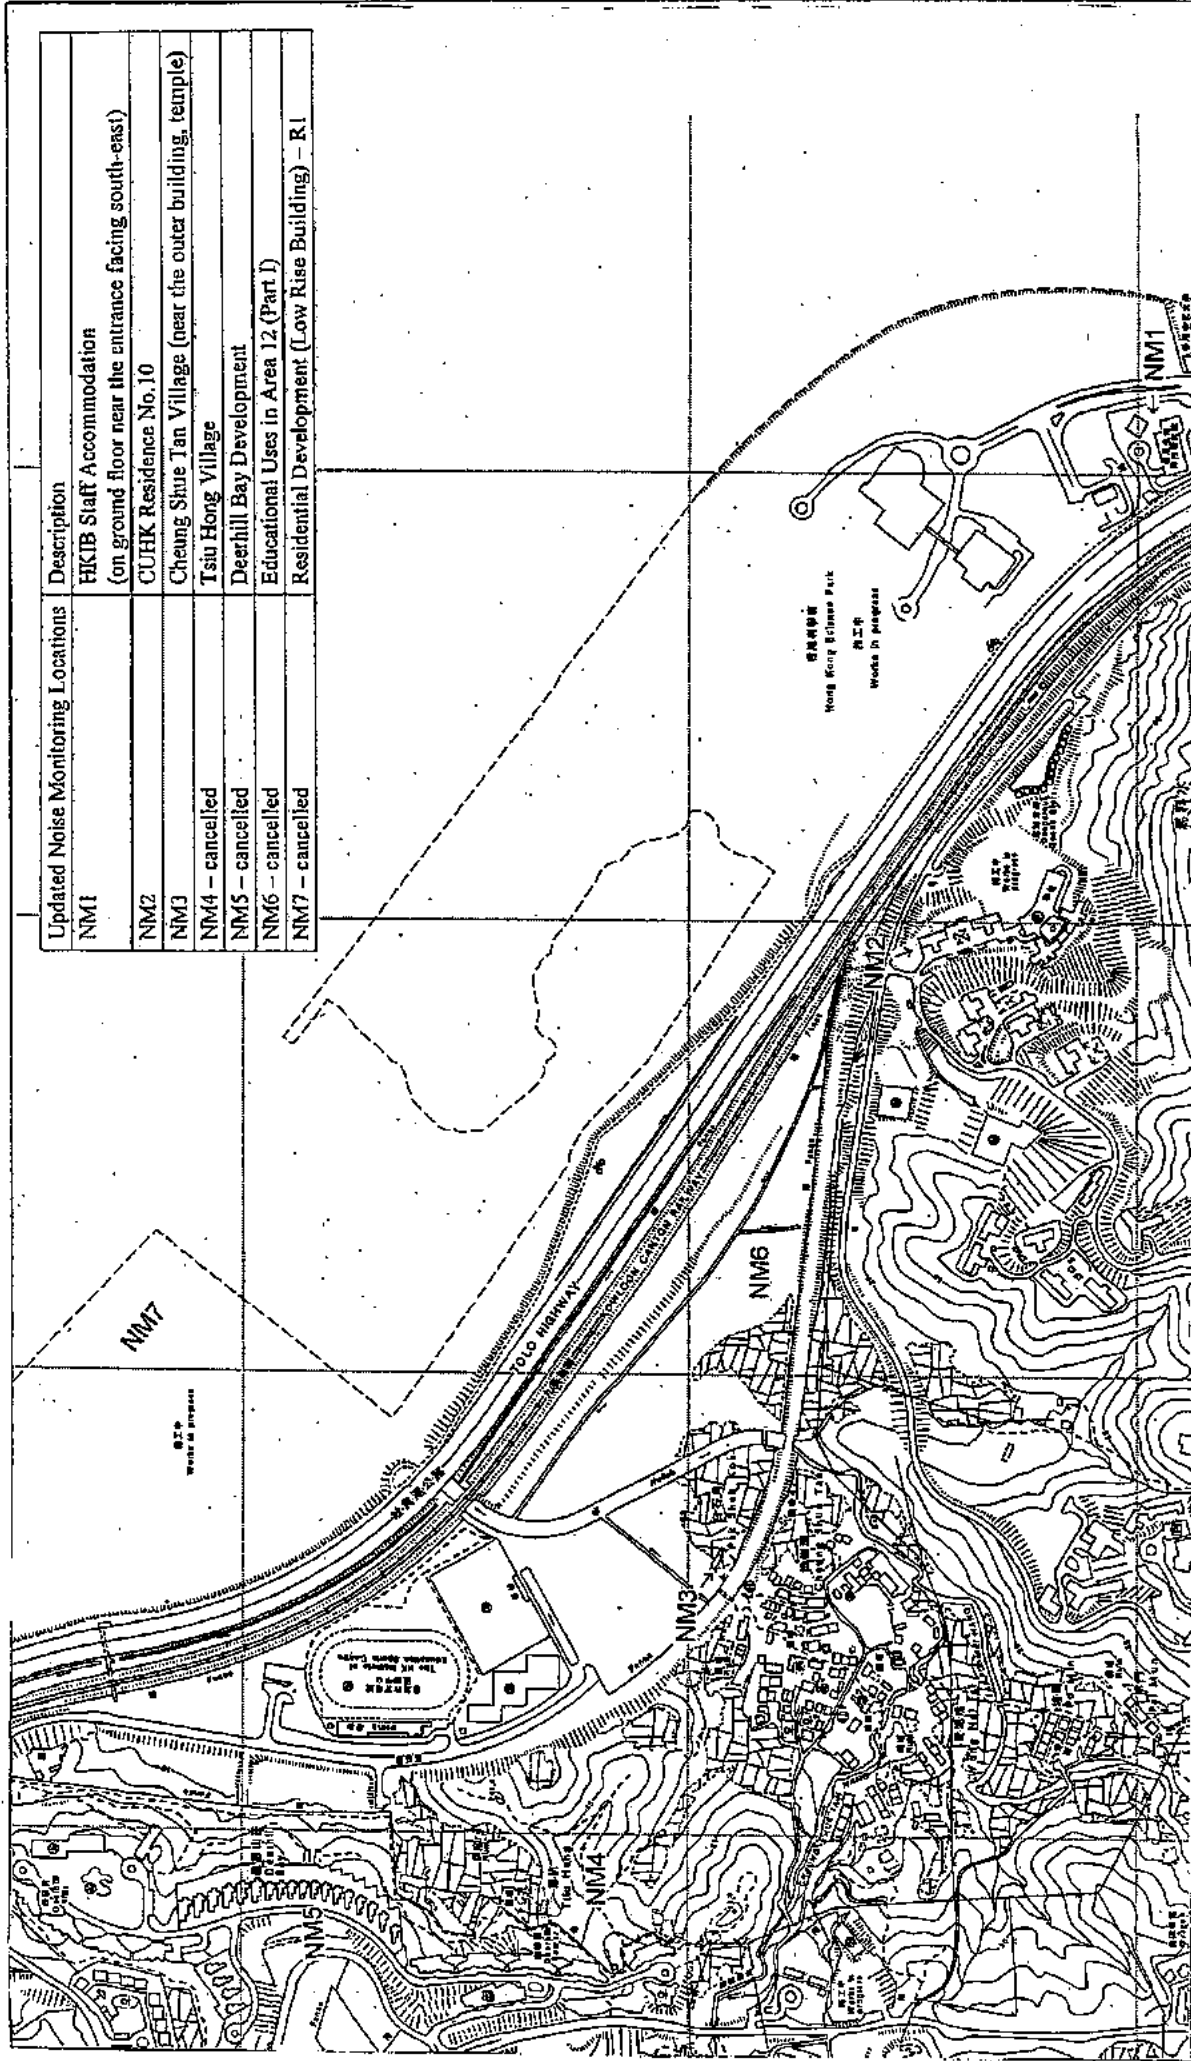


Scale : ---

Revised Date: 15/11/2002

Remaining Engineering Works for Pak Shek Kok Development, Package 1
 Contract No. TP35/02

Figure 1 Location of Noise Monitoring Stations

東業德動測試顧問有限公司
 ETS-TESTCONSULT LIMITED

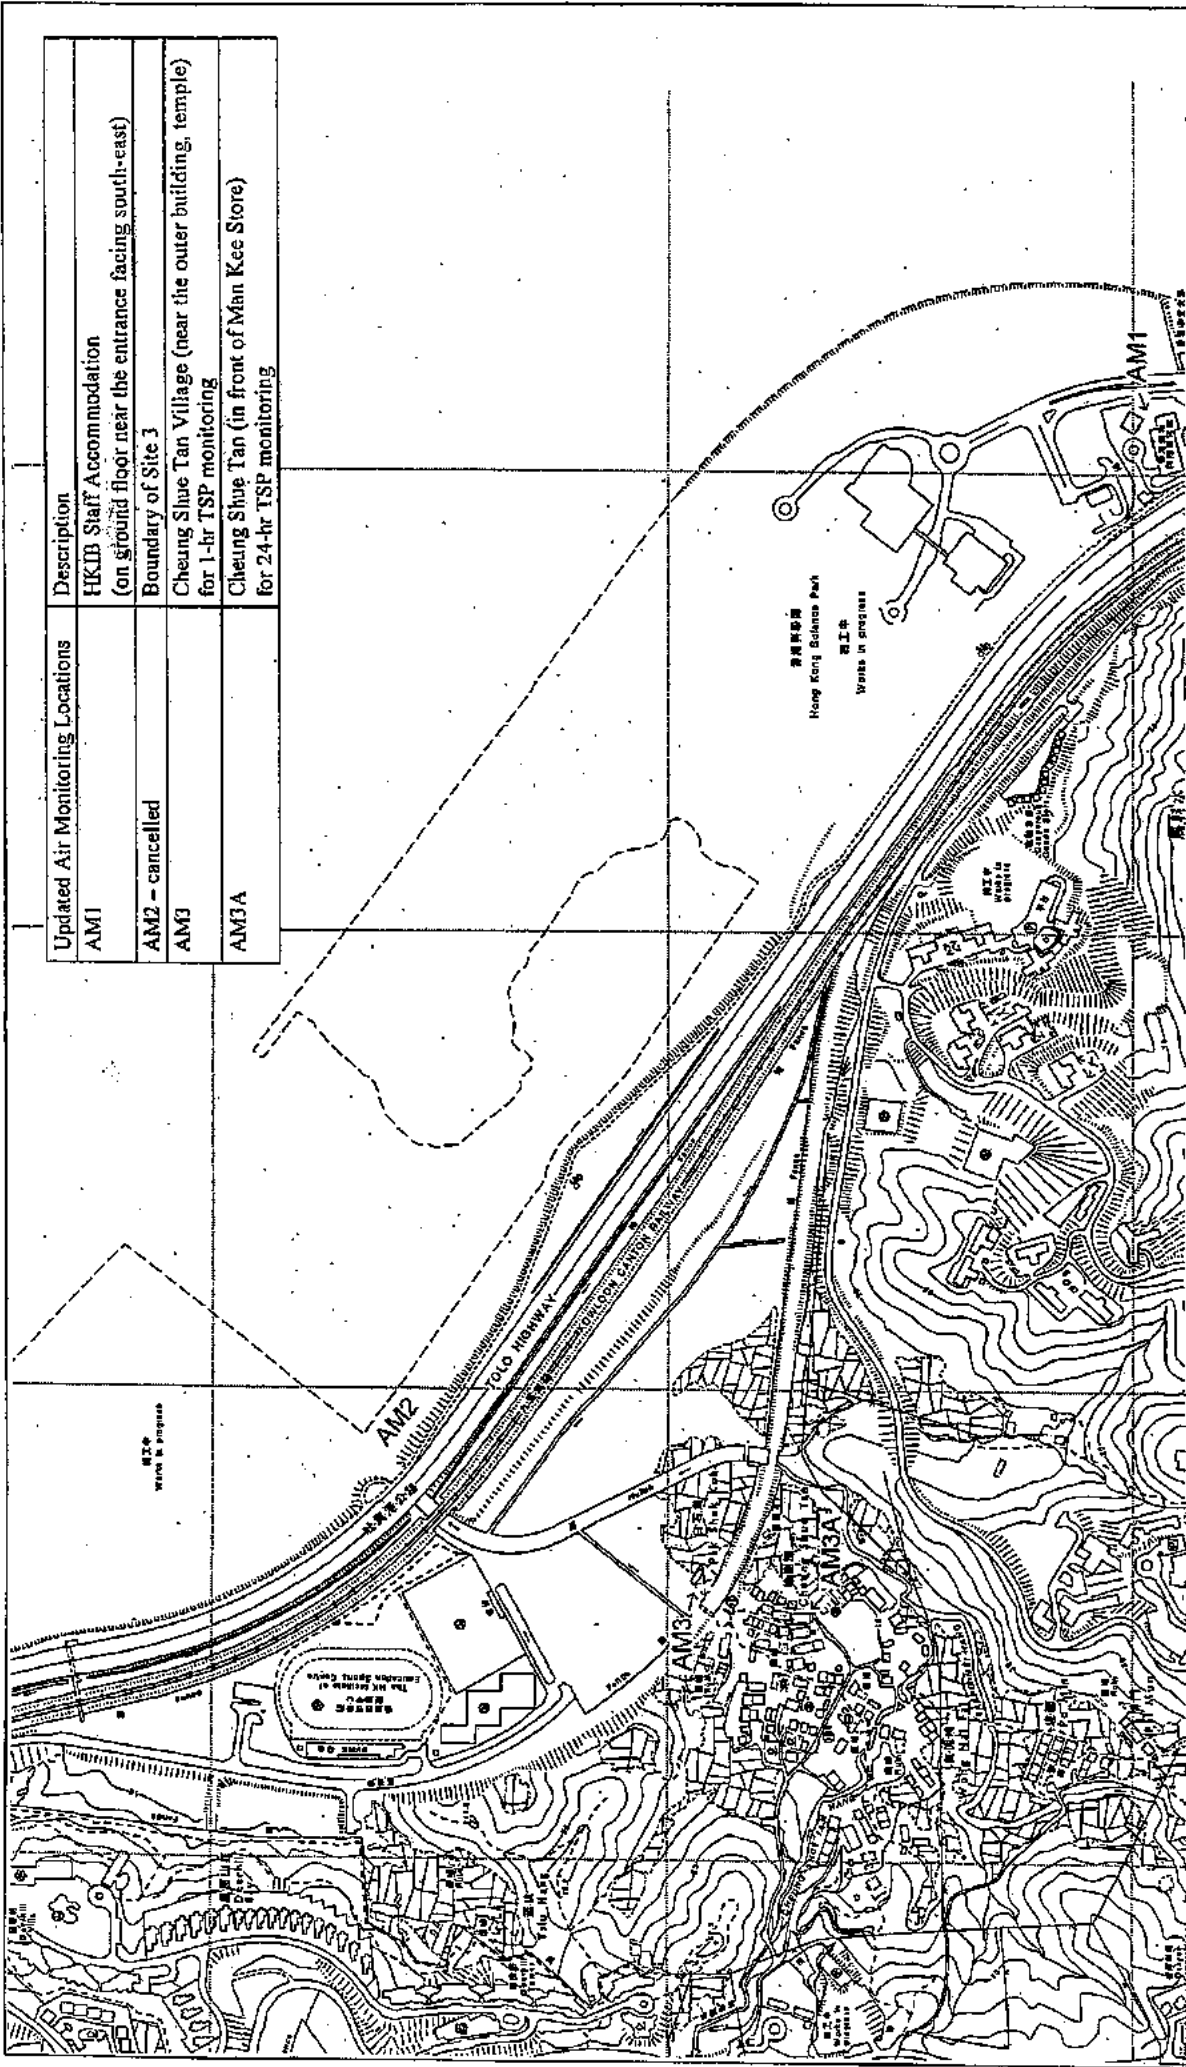


Updated Air Monitoring Locations	Description
AM1	HKIB Staff Accommodation (on ground floor near the entrance facing south-east)
AM2 - cancelled	Boundary of Site 3
AM3	Cheung Shue Tan Village (near the outer building, temple) for 1-hr TSP monitoring
AM3A	Cheung Shue Tan (in front of Man Kee Store) for 24-hr TSP monitoring

Scale : ----

Remaining Engineering Works for Pak Shek Kok Development, Package 1
 Contract No. TP35/02


Revised Date:

15/11/2002

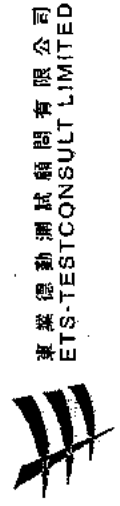

東業德動測試顧問有限公司
 ETS-TESTCONSULT LIMITED

Figure 2 Location of Air Monitoring Stations

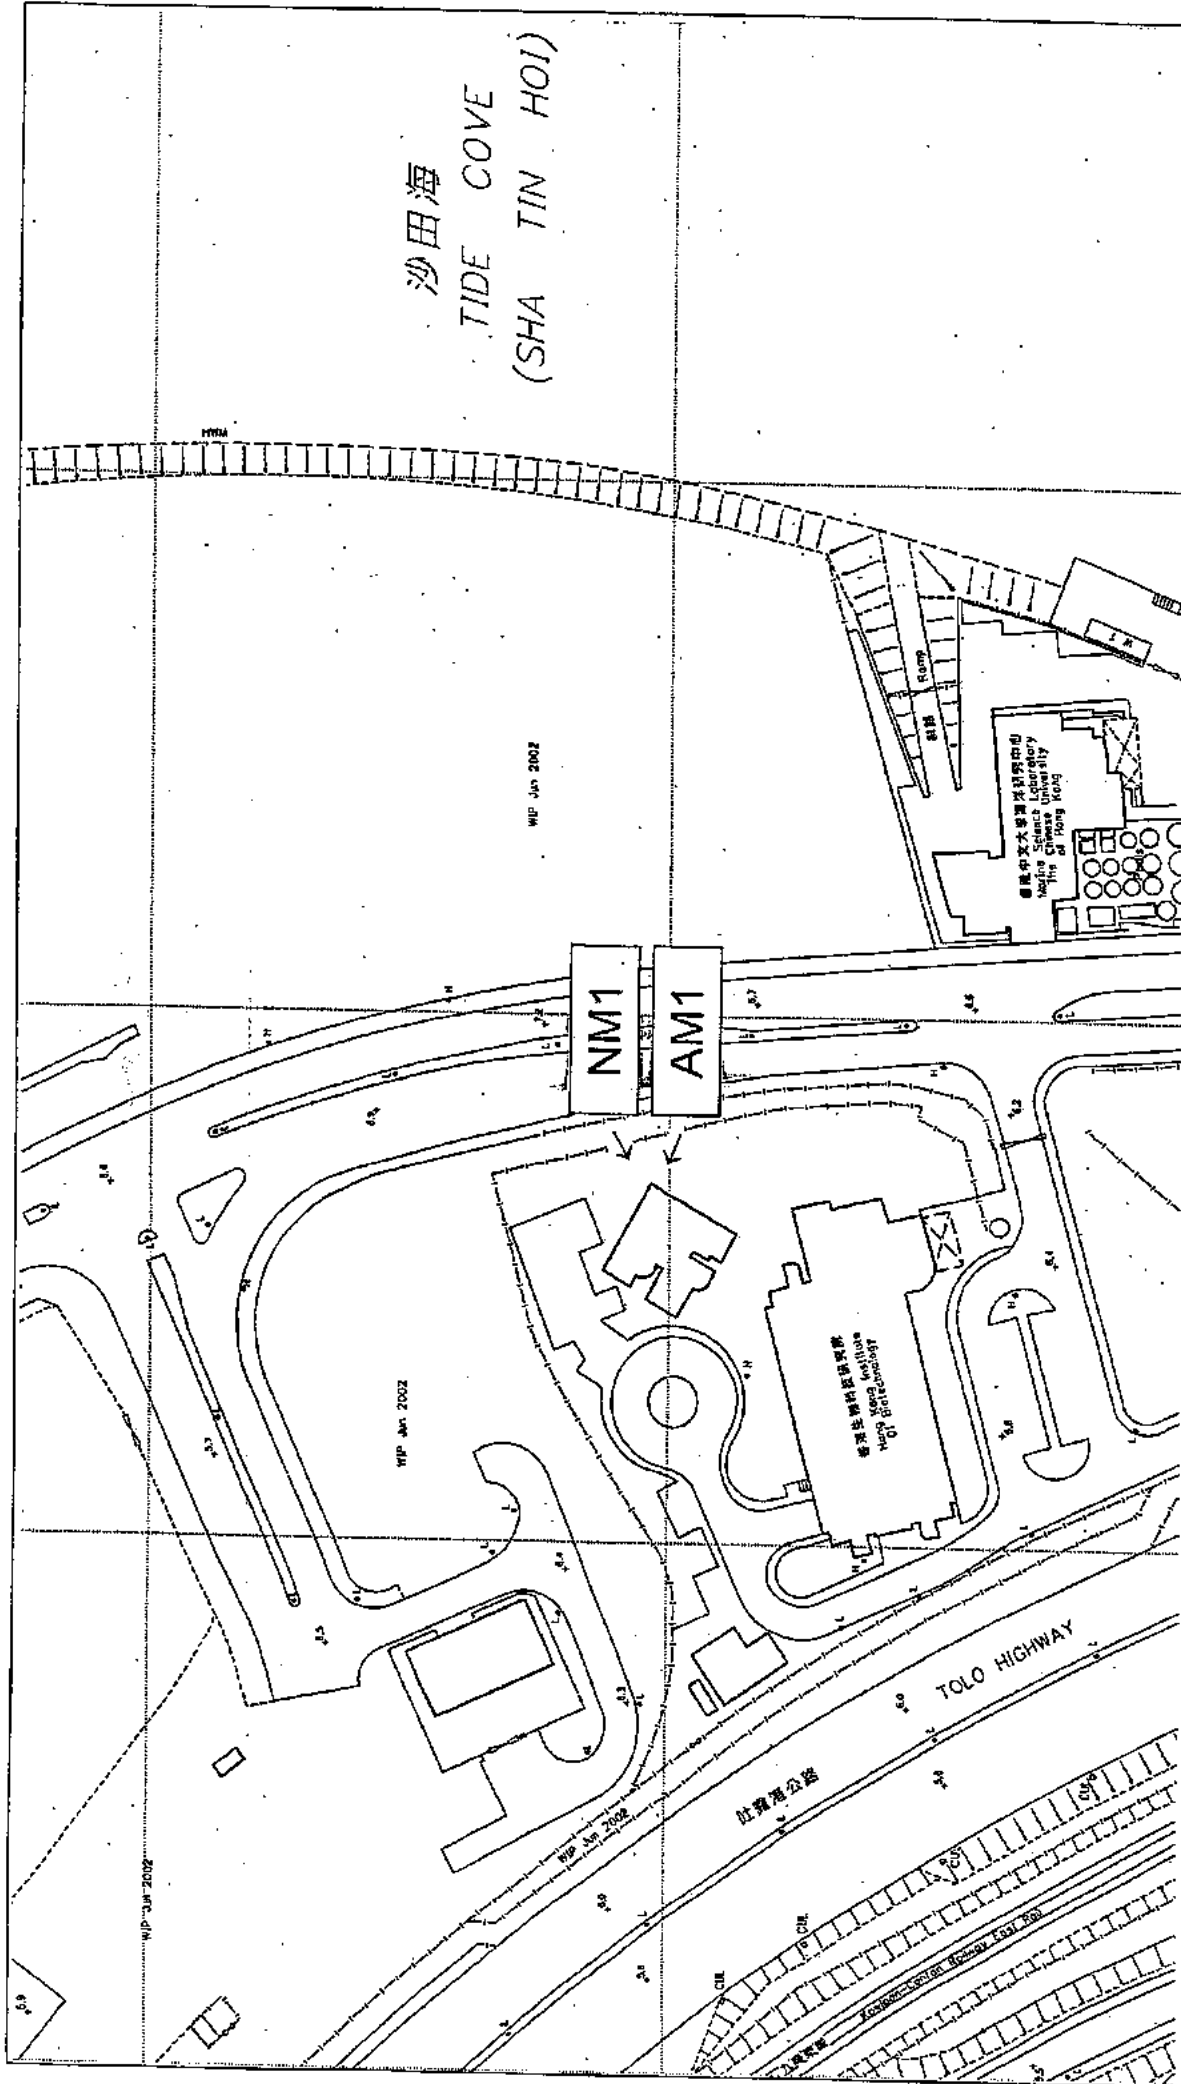

Remaining Engineering Works for Pak Shek Kok Development, Package 1
 Contract No. TP35/02

Figure 3 Location of Air and Noise Monitoring Stations
 at HKIB Staff Accommodation


Scale : ---

Revised Date:

15/11/2002



東業德動測試顧問有限公司
 ETS-TESTCONSULT LIMITED

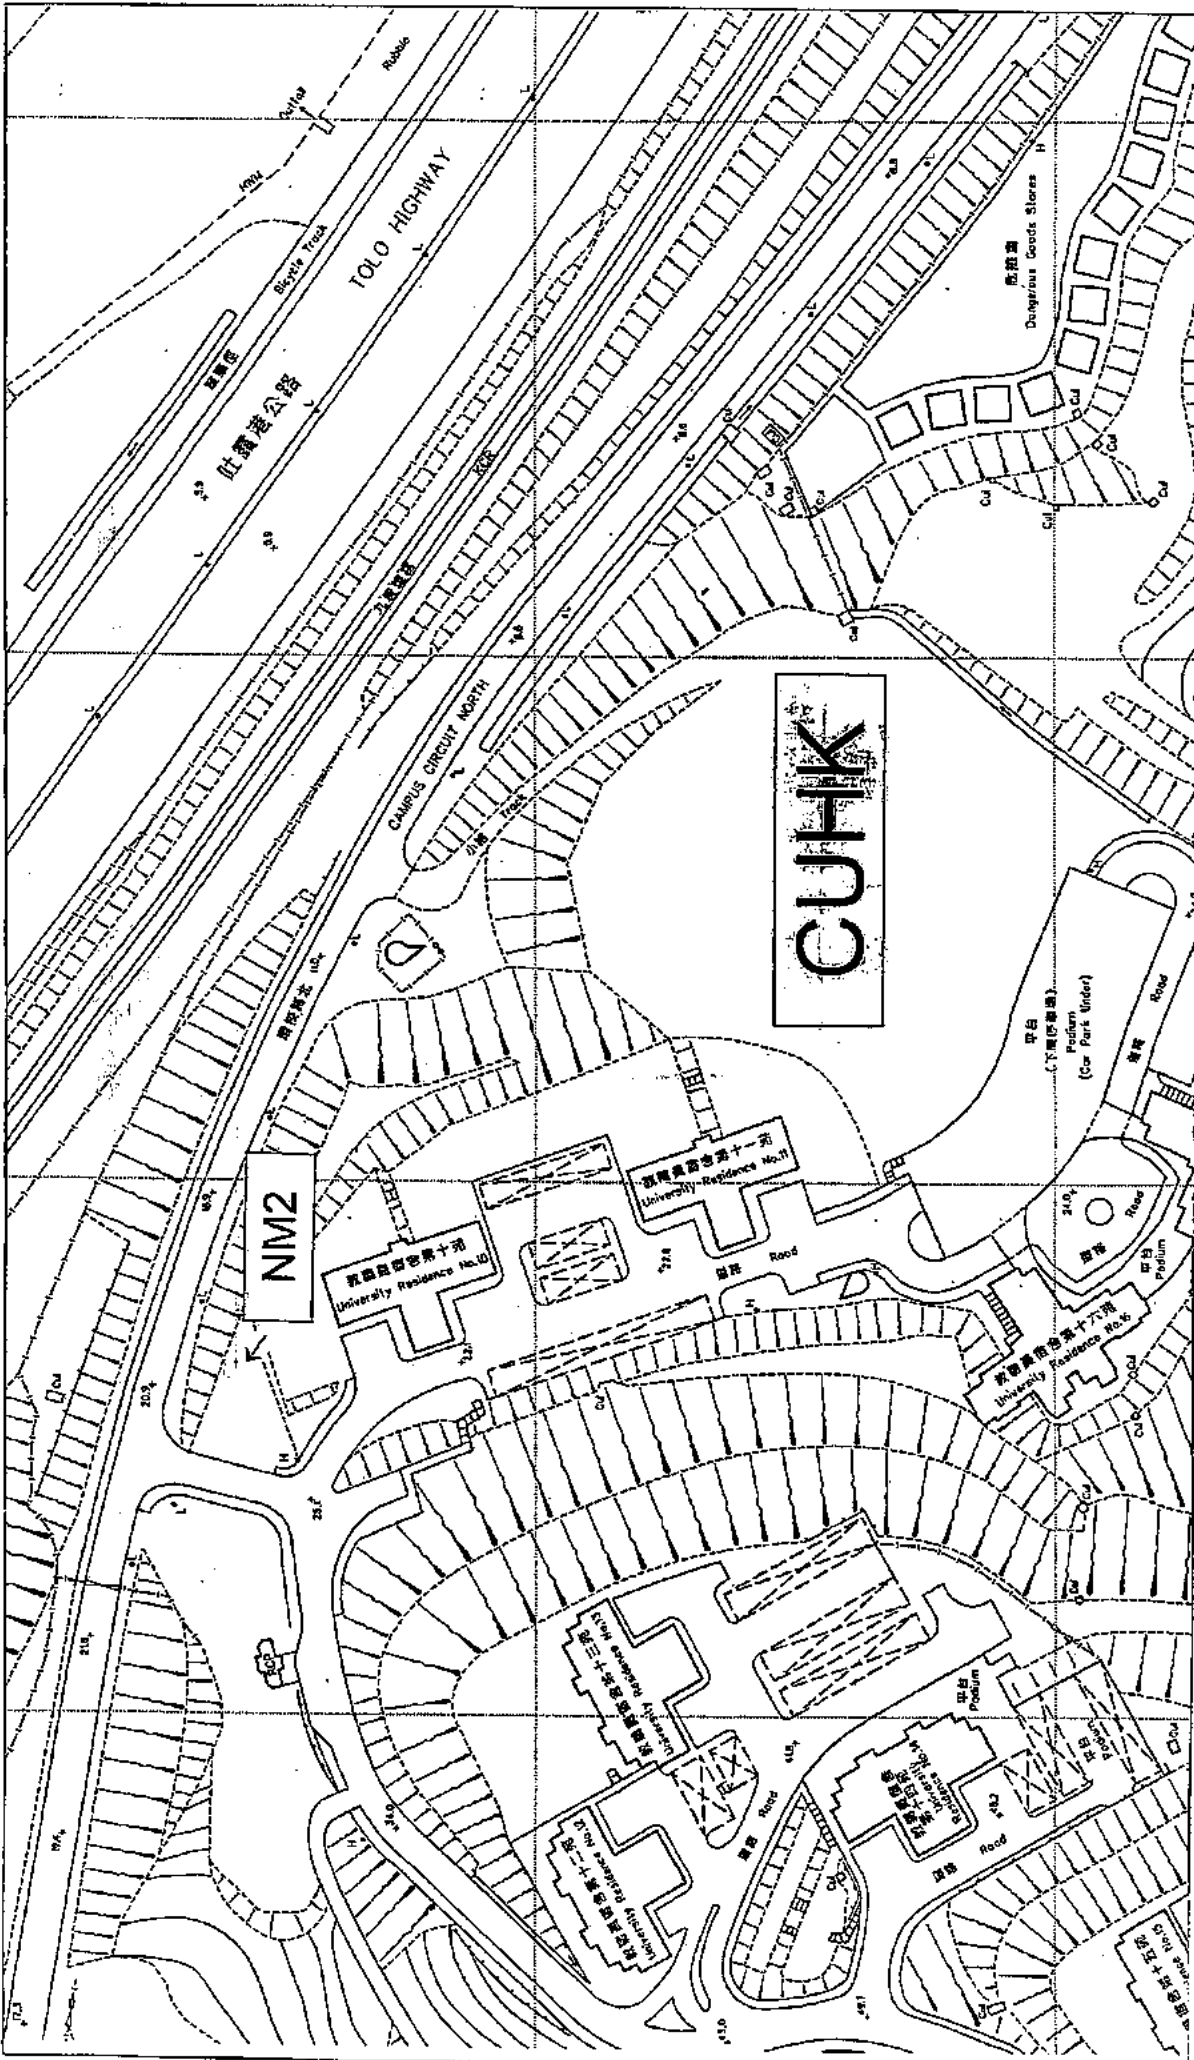

Scale : ---


Remaining Engineering Works for Pak Shek Kok Development, Package 1
 Contract No. TP35/02

Figure 4 Location of Noise Monitoring Station at CUHK Residence No.10



東慈律動測試顧問有限公司
 ETS-TESTCONSULT LIMITED

Revised Date: 15/11/2002

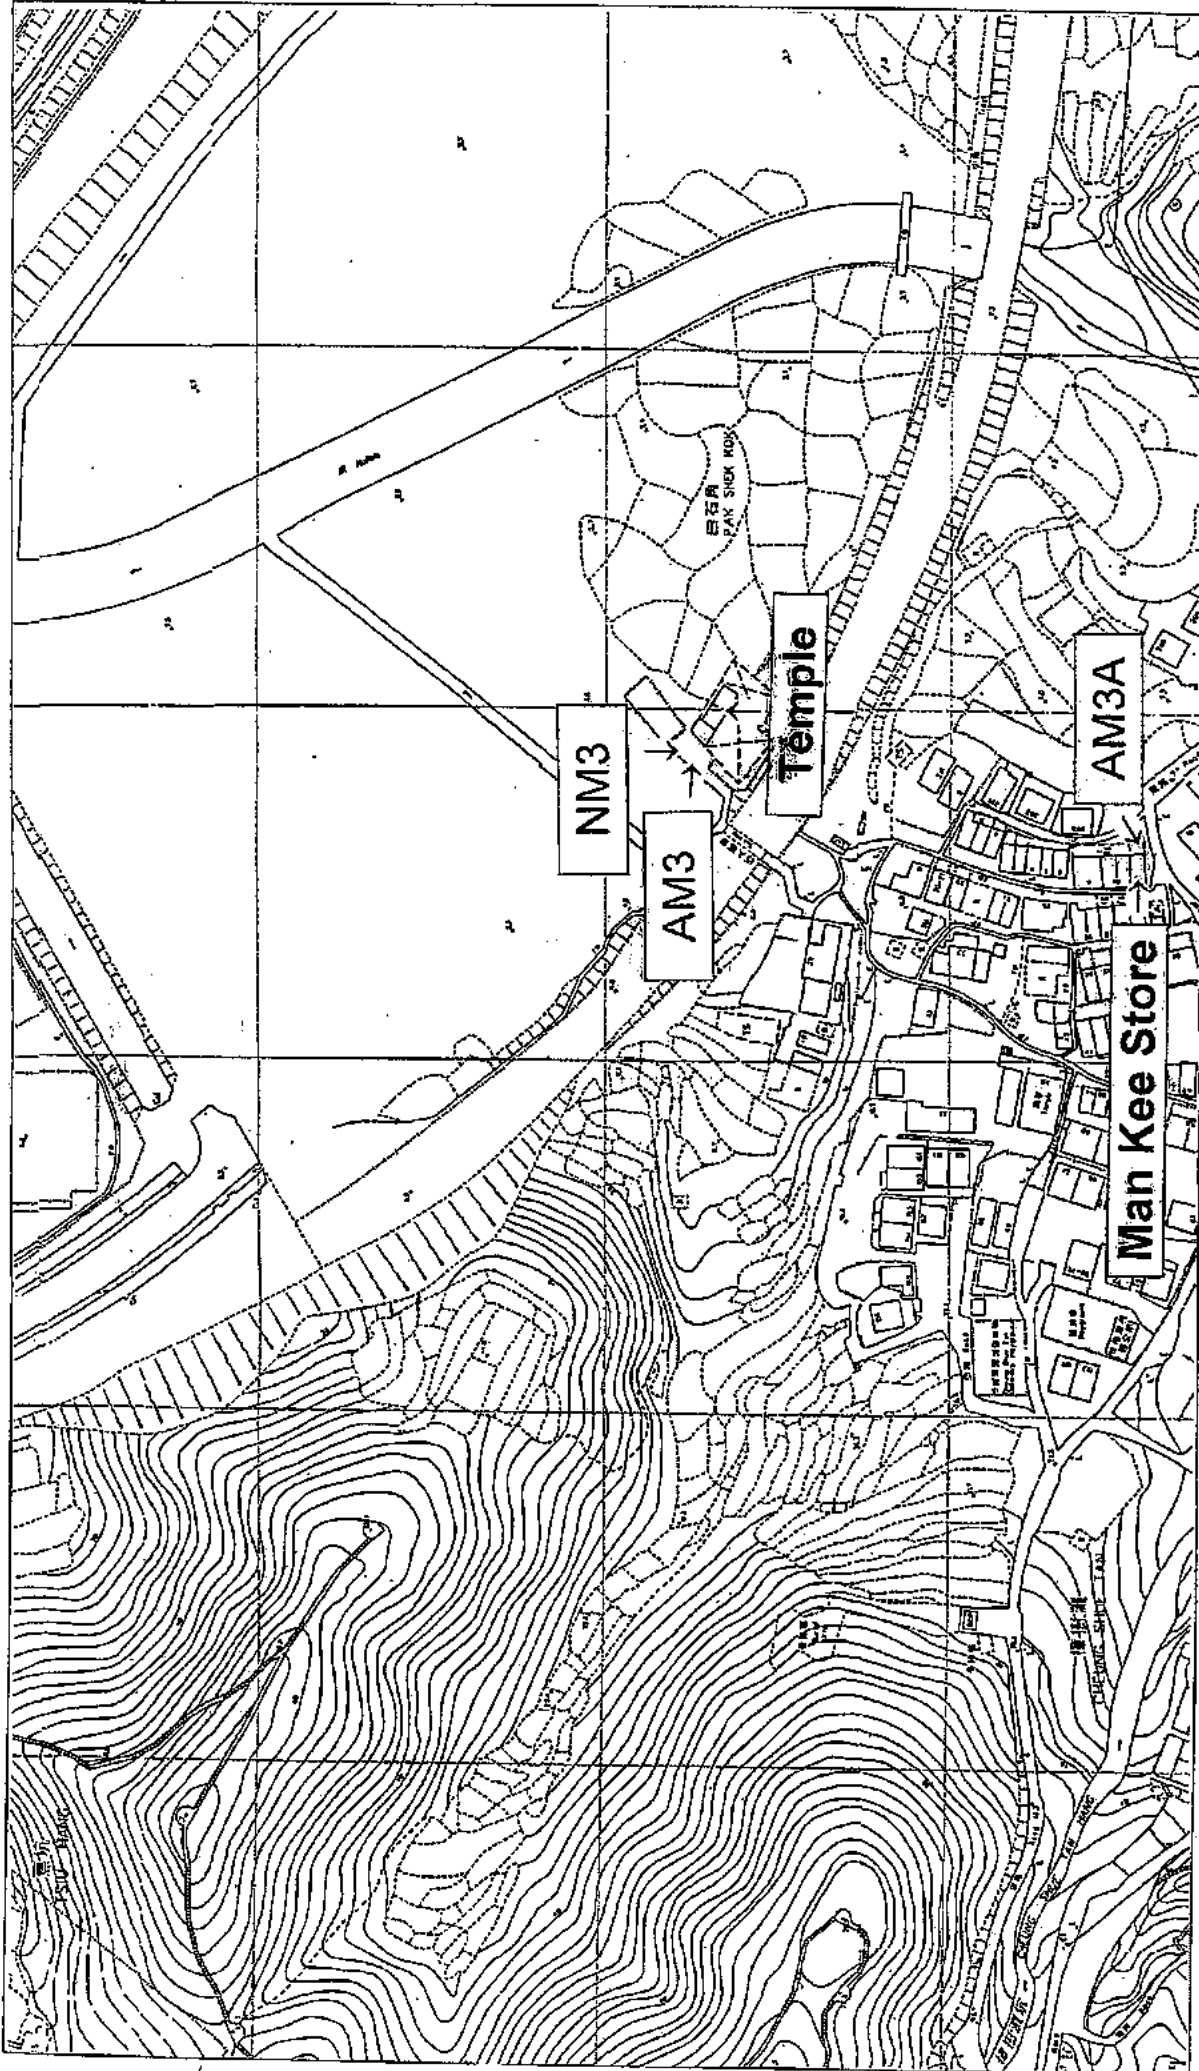

Remaining Engineering Works for Pak Shek Kok Development, Package 1
 Contract No. TP35/02

Figure 5 Location of Air and Noise Monitoring Stations
 at Cheung Shue Tan Village

Scale : ---

Revised Date:

15/11/2002



英業德動測試顧問有限公司
 ETS-TESTCONSULT LIMITED