



PROJECT No.: TCS/00408/08

DSD CONTRACT NO. DC/2007/17
DRAINAGE IMPROVEMENT WORKS IN
CHEUNG PO, MA ON KONG, YUEN KONG SAN TSUEN
AND TIN SAM TSUEN OF YUEN LONG DISTRICT AND
SEWERAGE AT TSENG TAU CHUNG TSUEN, TUEN MUN

MONTHLY EM&A REPORT FOR KT13
(JULY 2010)

PREPARED FOR
CHINA ROAD & BRIDGE CORPORATION

Quality Index

Date	Reference No.	Prepared By	Certified by
13 August 2010	TCS00408/08/600/R1480v2	 Nicola Hon Environmental Consultant	 T.W. Tam Environmental Team Leader

Version	Date	Prepared by:	Certified by:	Description
1	10 August 2010	Nicola Hon	T.W. Tam	First submission
2	13 August 2010	Nicola Hon	T.W. Tam	Amended against IEC's comments on 12 August 2010

This report has been prepared by Action-United Environmental Services & Consulting with all reasonable skill, care and diligence within the terms of the Agreement with the client, incorporating our General Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client. We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above. This report is confidential to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies upon the report at their own risk.

Ove Arup & Partners
奧雅納工程顧問

Our ref 25211/L203/CN/cl

Date 13 August 2010

Level 5, Festival Walk
80 Tat Chee Avenue
Kowloon Tong, Kowloon
Hong Kong
Tel +852 2528 3031
Fax +852 2268 3950
Direct Tel +852 2268 3097
coleman.ng@arup.com

By Fax and Post

www.arup.com

Black & Veatch Hong Kong Limited
25/F, Millennium City 6
392 Kwun Tong Road
Kowloon
Hong Kong

Attention: Ms. Jenny Lui (Fax: 2478 9396)

ARUP

Dear Ms. Lui,


Contract No. DC/2007/17 Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen King San and Tin Sam Tsuen of Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun Monthly EM&A Report for KT13 (July 2010) – Version 2

We refer to the captioned report (ref.: TCS00408/08/600/R1480v2) and advise that we have no further comments on the captioned submission.

We hereby endorse the captioned report for your onward submission.

If you require any further information, please do not hesitate to contact the undersigned.

Yours sincerely,

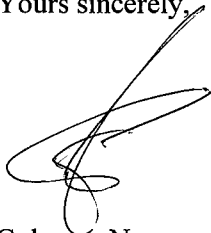

Coleman Ng
Independent Environmental Checker

cc: China Road and Bridge Corporation (Mr. Raymond Mau) (Fax: 2478 9612)
AUES (Mr. TW Tam / Ms. Nicola Hon) (Fax: 2959 6079)

Executive Summary

ES01 This is the 22nd monthly EM&A report for the Channel KT13, covering the construction period from 26 June to 25 July 2010 (the Reporting Period).

Breaches of Action and Limit Levels

ES02 Monitoring results of the Reporting Period demonstrated no exceedances of environmental quality criteria for air quality and construction noise monitoring.

ES03 For stream water quality monitoring, a total of 3 Limit level exceedances in Suspended Solids were recorded at impact station W2 and W6. Investigation concluded that the exceedances were not project related.

ES04 Monthly Ho Pui egret survey and Ma On Kong egret survey was conducted on 24 July 2010. In comparing the monitoring result in 2009, no exceedance was recorded in this reporting month.

ES05 Four (4) events of weekly settlement monitoring for the historic grave were undertaken in this reporting month. The monitoring results demonstrated no exceedances recorded in the survey.

ES06 Landscape inspections were conducted on 6 and 19 July 2010. No significant changes were observed for the identified landscape resources and visual sensitive receivers, except for minor changes due to channel excavation, site clearance and preparation work at the identified landscape resources including LR1, LR2.1, LR2.2, LCA1, LCA3 and LCA4.

Environmental Complaint, Notification of Summons and Prosecution

ES07 No documented complaint, notification of summons or successful prosecution was received during the Reporting Period. Environmental audit of the Reporting Period indicated that the implemented mitigation measures for air quality, construction noise and ecology were effective. Minor deficiencies found in the weekly site inspection were in general rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.

Reporting Changes

ES08 No reporting changes were made during the Reporting Period.

Future Key Issues

ES09 During wet season, water quality mitigation measures to avoid ingress of runoff into Channel KT13 should be properly installed and maintained. It is reminded that sand bund at the channel should be maintained and repaired regularly to cater additional water flows.

ES10 Special attention should be paid on construction noise and other environmental issues identified in the EM&A Manual as recommended in the EIA and summarized in Mitigation Measure Implementation Schedule. CRBC was reminded to implement the required mitigation measures during construction, in particular when excavation are undertaken or any soil stockpile located within the working site and dust emissions is generated and impacted surrounding environmental nearby Channel KT13.

Table of Contents

1	ENVIRONMENTAL STATUS	- 1 -
1.1	PROJECT AREA AND CONSTRUCTION PROGRAMME	- 1 -
1.2	WORKS UNDERTAKEN DURING THE REPORTING PERIOD	- 1 -
1.3	ENVIRONMENTAL MANAGEMENT ORGANIZATION.....	- 1 -
1.4	LICENSING STATUS.....	- 1 -
1.5	ENVIRONMENTAL PROTECTION AND POLLUTION CONTROL MITIGATION MEASURES	- 2 -
2	MONITORING METHODOLOGY	- 3 -
2.1	MONITORING PARAMETERS	- 3 -
2.2	MONITORING LOCATIONS	- 3 -
2.3	MONITORING FREQUENCY, DURATION AND SCHEDULE.....	- 4 -
2.4	MONITORING EQUIPMENT AND PROCEDURE	- 6 -
2.5	QUALITY ASSURANCE PROCEDURES AND DATA MANAGEMENT	- 10 -
2.6	REPORTING	- 11 -
3	MONITORING RESULTS	- 12 -
3.1	AIR QUALITY	- 12 -
3.2	CONSTRUCTION NOISE	- 12 -
3.3	WATER QUALITY	- 14 -
3.4	ECOLOGY	- 15 -
3.5	WASTE MANAGEMENT, CULTURAL HERITAGE AND LANDSCAPE & VISUAL.....	- 15 -
4	NON-COMPLIANCE, COMPLAINT, NOTIFICATION OF SUMMONS, SUCCESSFUL PROSECUTION AND OTHERS	- 19 -
4.1	NON-COMPLIANCE	- 19 -
4.2	ENVIRONMENTAL COMPLAINT	- 19 -
4.3	NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTION	- 19 -
4.4	OTHERS	- 19 -
5	CONCLUSIONS AND RECOMMENDATIONS.....	- 21 -

LIST OF TABLES

Table 2-1	Summary of Monitoring Parameters
Table 2-2	Summary of Monitoring Locations
Table 2-4-2	Air Quality Monitoring Equipment
Table 2-4-3	Construction Noise Monitoring Equipment
Table 2-4-4	Water Quality Monitoring Equipment
Table 2-6	Requirements for Report Submission
Table 3-1-1	Air Quality Action and Limit Levels
Table 3-1-2-1	Summary of Air Quality Monitoring Results at KT13-A1(a)
Table 3-1-2-2	Summary of Air Quality Monitoring Results at KT13-A2
Table 3-2-1	Construction Noise Action and Limit Levels
Table 3-2-2-1	Summary of Construction Noise Monitoring Results – N1(a)
Table 3-2-2-2	Summary of Construction Noise Monitoring Results – N2(a)
Table 3-2-2-3	Summary of Construction Noise Monitoring Results – N3
Table 3-3-1	Action and Limit Levels for Water Quality Monitoring
Table 3-3-2	Summary of Water Quality Exceedances
Table 3-4-1	Ecological Action and Limit Levels
Table 3-4-2	Summary of KT13 Ecology Impact Monitoring Bird Survey
Table 3-5-2	Cultural Heritage Resources Action and Limit Levels
Table 3-5-3	Record of Five Settlement Marker Points of the Qing Dynasty Grave
Table 4-4-1	Summary of Findings of Site Inspection and Environmental Audit

LIST OF APPENDICES

Appendix A	Location Plan of the Project and Environmental Monitoring Locations under the Project
Appendix B	Construction Program
Appendix C	Environmental Management Organization and Contacts of Key Personnel
Appendix D	Monitoring Schedules and Meteorological Data
Appendix E	Calibration Certificates and HOKLAS-Accreditation Certificate
Appendix F	Event Action Plan
Appendix G	Environmental Monitoring Results and Graphical Plots
Appendix H	Photographic Records of Ecological Monitoring of Vegetation (Not Used)
Appendix I	Condition Survey of the Grave during Construction Phase (Not Used)
Appendix J	Physical, Human and Cultural Landscape Resources at KT13
Appendix K	Monthly Summary Waste Flow Table

1 ENVIRONMENTAL STATUS

This is the **22nd** monthly EM&A report for KT13, covering the construction period from **26 June to 25 July 2010** (the Reporting Period).

1.1 PROJECT AREA AND CONSTRUCTION PROGRAMME

Drawings showing the project area, any environmental sensitive receivers and the locations of the monitoring and control stations are presented in **Appendix A**, and the construction program in **Appendix B**.

1.2 WORKS UNDERTAKEN DURING THE REPORTING PERIOD

Apart from general works of tree survey, structural survey and environmental monitoring & audit, works undertaken during the Reporting Period with fine tuning of construction activities showing the inter-relationship with environmental protection/mitigation measures for the month are summarized as follows:

- Excavation of channel formation
- Construction of channel structure
- Backfilling
- Installation of type 2 railing
- Laying of underground drain pipe
- Laying of Gabion Block/Granite Block

1.3 ENVIRONMENTAL MANAGEMENT ORGANIZATION

Management structure and key personnel contact names and telephone numbers of the environmental management organization are presented in Appendix C, where DSD is the Project Proponent; CRBC is the main Contractor; EPD and AFCD are the supervisory departments for environmental protection of the Project; BVHKL is the Engineer's Representative of DSD (the ER); ARUP is the Independent Environmental Checker (the IEC) and Action-United Environmental Services and Consulting (AUES) is the environmental team (the ET).

1.4 LICENSING STATUS

1.4.1 Air Pollution Control (Construction Dust) Regulation

Pursuant to the **Air Pollution Control (Construction Dust) Regulation**, CRBC has notified EPD, via submission of Form NA dated 14 February 2008, of the scope and nature of the works to be carried out under the Project, including construction activities such as stockpiling, loading and unloading, transfer of dusty material, use of vehicles and debris handling, etc. CRBC will continuously review the status of the environmental licenses and apply the required licenses/permits prior to the commencement of construction work.

1.4.2 Noise Control Ordinance

No **Construction Noise Permit** (CNP) is required for the Project pursuant to the Noise Control Ordinance (NCO) and the associated applicable subsidiary regulations of **Noise Control (General) Regulation, Noise Control (Hand-held Percussive Breaker) Regulation and Noise Control (Air Compressor) Regulation**, as the use of powered mechanical equipment, or conducting construction work in during restricted hours, i.e. 1900 to 0700 hours on normal weekdays and any time on general holidays including Sundays is not anticipated during the whole construction period. CRBC will continuously review the status of the environmental licenses under the NCO and apply the required licenses/permits prior to the commencement of construction work.

1.4.3 Waste Disposal (Charges for Disposal of Construction Waste) Regulation

CRBC has applied for a Billing Account (Construction Work Contract with Value of \$1million or above), under the **Waste Disposal (Charges for Disposal of Construction Waste) Regulation**. The account number 7006524 has been assigned on 9 Jan 2008.

1.4.4 Water Pollution Control Ordinance

CRBC has applied for a discharge license under Section 20 of the **Water Pollution Control Ordinance**, and the license No. 1U461/1 has been issued.

1.4.5 Waste Disposal (Chemical Waste) (General) Regulation

CRBC has registered as a Chemical Waste Producer with EPD under the Waste Disposal (Chemical Waste) (General) Regulation and the Waste Producer Number assigned is WPN: 5611-531-C3124-28 dated 2 May 08.

1.4.6 Dumping at Sea Permit

CRBC has been granted by the Environmental Protection Department a Permit Issued under the **Dumping at Sea Ordinance** (Permit no. EP/I4D/08-095, dated 18 September 2008, permit validity period of six months from 18 September 2008 to 17 March 2009) for disposal of 18,469 m³ sediment, requiring Type 1 – open sea disposal at East Sha Chau Contaminated Mud Disposal Site – Pit IV b, to be capped as directed by the Management Team of the Civil Engineering and Development Department. Note that this permit has expired. As there is no need for further sea disposal, no further permits will be required in the future.

1.5 ENVIRONMENTAL PROTECTION AND POLLUTION CONTROL MITIGATION MEASURES

CRBC has committed to implement environmental protection and pollution control and mitigation measures, as recommended in the EIA, EP, EM&A Manuals, and summarized in the Mitigation Measures Implementation Schedules. The implemented mitigation measures include

- (a) Watering of stockpiles of rip-rap at KT13;
- (b) Covering of the loose soil at KT13 to minimize water quality impacts;
- (c) Hard pavement of haul road leading to public roads at KT13;
- (d) Classification and disposal of illegally dumped construction and demolition materials at KT13;
- (e) Construction of noise barriers; and
- (f) Erection of dams with sand bags downstream the excavation site within the water course of KT13 to enhance sedimentation of turbidity and suspended solids (SS).

2 MONITORING METHODOLOGY

2.1 MONITORING PARAMETERS

According to the EM&A requirements set out in the EIA, Environmental Permit No. EP263/2007 (the EP) and the associated EM&A Manual, the required monitoring parameters are summarized as follows.

Table 2-1 Summary of Monitoring Parameters

Environmental Issue	Monitoring Parameters	
Air Quality	(a) 1-hour Total Suspended Particulate (1-hour TSP); and (b) 24-hour Total Suspended Particulate (24-hour TSP).	
Construction Noise	(a) A-weighted equivalent continuous sound pressure level (30min) (Leq(30min) during the normal working hours; and (b) A-weighted equivalent continuous sound pressure level (5min) (Leq(5min) for construction work during the Restricted Hours.	
Water Quality	(a) In Situ Measurement	temperature, dissolved oxygen (DO), pH & turbidity
	(b) Laboratory Analysis	suspended solids (SS), Ammonia Nitrogen (NH ₃ -N) and Zinc (Zn)
Ecology	Vegetation, all bird species of wetland, Ho Pui Egret, Ma On Hong Egret and Flight Line Survey	
Waste Management	Inspection and the document audit	
Cultural Heritage	Condition survey for a historical grave	
Landscape & Visual	To audit the implementation of the proposed construction phase mitigation measure stipulated in EIA.	

2.2 MONITORING LOCATIONS

Details of the monitoring locations are summarized in **Table 2-2** and shown in **Appendix A**. For ease of reference, monitoring locations denoted with “(a)” are relocated locations to differentiate them from the original ‘EM&A Manual’ locations.

Table 2-2 Summary of Monitoring Locations

Environmental Issues	Monitoring Location	Identified Address / Co-ordinates	Status of Monitoring Locations / Rationale for Recommended Replacement
Air	A1(a)	No.68 Ho Pui Village	The original location of EM&A Manuals A1 has permanently been abandoned. No access can be acquired in the vicinity of A1. Taken into consideration that Ho Pui Village is one of the most important sensitive receivers near KT-13 without monitoring, the most fronting house, No. 68 Ho Pui Village, is therefore recommended as the replacement location A1(a).
	A2	No.1 Ma On Kong Village	Original location of the EM&A Manual; access granted.
Noise	N1(a)	168-169 Kam Ho Road, Ma On Kong Village,	Original location of N1 identified in the EM&A Manual was relocated to proposed area as recommended by IEC.
	N2(a)	No. 68 Ho Pui Village,	The original location of EM&A Manuals N2 has permanently been abandoned. No access can be acquired in the vicinity of N2. Taken into consideration that Ho Pui Village is one of the most important sensitive receivers near KT-13 without monitoring, the most fronting house, No. 68 Ho Pui Village, is therefore recommended as the replacement location N2(a).
	N3	No.1 Ma On Kong Village	Original locations of the EM&A Manual; access granted.
Water	W1	E824539 / N830283	Original locations of the EM&A Manual; access resolved.

Environmental Issues	Monitoring Location	Identified Address / Co-ordinates	Status of Monitoring Locations / Rationale for Recommended Replacement
	W2	E824693 / N830258	Original locations of the EM&A Manual; access resolved.
	W3(a)	E824833 / N830374	The W3 is proposed to be relocated about 55 m down stream to W3(a) for safety reason as there is no any discharge point observed between W3 and the proposed W3(a).
	W4	E824936 / N830618	Original locations of the EM&A Manual; access resolved.
	W5	E825008 / N830812	Original locations of the EM&A Manual; access resolved.
	W6	E825100 / N830987	Original locations of the EM&A Manual; access resolved.
Ecology	Monthly monitoring along the boundary of the works area to confirm that there are no adverse impacts on habitats outside the site in particular the Conservation Area (CA) zone and Ho Pui Egretty. Photographic records at six-month intervals; Monthly monitoring of all bird numbers including wetland species and species identified as being of conservation importance; Monitoring of Ho Pui egretty during March to August. The Ma On Kong egretty is also surveyed to provide reference information on the breeding egrets nearby; and Flight line surveys twice per month during April to June.		
Waste Management	Whole construction site and document		
Cultural Heritage	Ma On Kong	Refer to EM&A Manual (KT13) Figure 7.1.	
Landscape & Visual	Refer to EIA Section 10		

2.3 MONITORING FREQUENCY, DURATION AND SCHEDULE

2.3.1 Monitoring Frequency and Duration

Environmental monitoring is conducted upon commencement of the construction activities and throughout the whole construction period to detect and minimize any adverse environmental impacts generated from the construction activities of the Project. The monitoring frequency and duration for air quality, construction noise, water quality, ecology and other parameters are summarized below.

Air Quality

Frequency: Once every 6 days for 24-hour TSP and three times every 6 days for 1-hour TSP, when the highest construction dust impacts are anticipated.

Duration: Throughout the construction period

Construction Noise

Frequency: Measurement of Leq(30min): Once a week during 0700-1900 hours on normal weekdays. If the construction work is undertake at restricted hours, the frequency of noise monitoring will be conducted in accordance with the requirements under the related Construction Noise Permit issued by EPD as follows:

- 3 consecutive Leq(5min) at restrict hour from 1700 – 2300 hours;
- 3 consecutive Leq(5min) for restrict hour from 2300 – 0700 hours next day;
- 3 consecutive Leq(5min) for Sunday or public holiday from 0700 – 1900 hours;

Duration: Throughout the construction period

Water Quality

Frequency: Three times a week with at least 36 hour intervals between any two consecutive monitoring events

As the water columns in the stream water within KT13 is generally less than 3m, measurement is performed at the mid-depths of the monitoring locations. In case the water columns are deeper than 6m, measurement shall be carried out at three water depths, namely, 1m below water surface, mid-depth, and 1m above river bed. If the water depths are between 3 to 6m, the mid-depth measurement is omitted.

Depths: As the water columns in the stream water within KT13 is generally less than 3m, measurement is performed at the mid-depths of the monitoring locations. In case the water columns are deeper than 6m, measurement shall be carried out at three water depths, namely, 1m below water surface, mid-depth, and 1m above river bed. If the water depths are between 3 to 6m, the mid-depth measurement is omitted.

Duration: Throughout the construction period.

Ecology

The Ecology Monitoring is required in accordance with the EM&A Manual.

Parameters: Vegetation, All bird species including wetland birds, Ho Pui and Ma On Hong Egrettries and Flight line survey

Frequency: Vegetation – Impact monitoring – monthly;
Photographic records/checks against baseline records– six monthly
Wetland Bird survey – Monthly of half-day survey;
Ma On Kong egrettry – Monthly between March to August; and
Ho Pui egrettry – Bi-weekly between March and August;
Flight line Survey – twice per Month during the period from April to June

Duration: Throughout the whole construction period

Waste Management Audit

Frequency: Once per month

Duration: Throughout the construction period.

Cultural Heritage

Scope: Condition survey and settlement monitoring of a Qing Dynasty Grave.

Frequency: Condition survey - Bi-monthly
Settlement monitoring - Bi-weekly

Duration: Throughout the construction phase period. (When construction work entered the 100m of the cultural heritage site)

Landscape & Visual

Frequency: Bi-weekly

Duration: Throughout the construction phase period.

2.3.2 Environmental Monitoring Schedule

The monitoring schedules for the Reporting Period and next month are presented in **Appendix D**.

2.4 MONITORING EQUIPMENT AND PROCEDURE

The monitoring equipment and procedures are summarized below. Calibration certificates of the equipment and the related laboratories are presented in **Appendix E**.

2.4.1 Weather Conditions during the Reporting Period

All meteorological information is extracted from the Hong Kong Observatory (Lau Fau Shan Station). The meteorological data include wind direction, wind speed, humidity, rainfall, air pressure and temperature etc., that are generally required for evaluating the environmental impact arising from the construction activities. The meteorological data are presented in **Appendix D**.

2.4.2 Air Quality

Monitoring Equipment

A list of air quality monitoring equipment is shown below.

Table 2-4-2 Air Quality Monitoring Equipment

Equipment	Model	Serial Number
24-hour TSP		
High Volume Air Sampler	Grasby Anderson GMWS 2310 HVS	-
Calibration Kit	TISCH Model TE-5025A	1612
1-hour TSP		
Portable Dust Meter	TSI DustTrak Model 8520	21060 / 23080 / 23079

Monitoring Procedure

1-hour TSP

The 1-hour TSP measurement follows manufacturer's Operation and Service Manual, using a 1-hour TSP monitor brand named TSI Dust Track Aerosol Monitor Model 8520 or Sibata LD-3 Laser Dust Meter, which is a portable, battery-operated laser photometer to record the real time 1-hour TSP based on 90° light scattering. The 1-hour TSP monitor consists of the following:

- (a) A pump to draw sample aerosol through the optic chamber where TSP is measured;
- (b) A sheath air system to isolate the aerosol in the chamber to keep the optics clean for maximum reliability; and
- (c) A built-in data logger compatible with Windows based program to facilitate data collection, analysis and reporting.

The 1-hour TSP meter to be used will be within the valid period, calibrated by the manufacturer prior to purchasing. Zero response of the instrument will be checked before and after each monitoring event.

24-hour TSP

The equipment used for 24-hour TSP measurement is the high volume air sampling system (hereinafter 'HVS') brand named Thermo Andersen, Model GS2310 TSP. The HVS complies with US EPA Code of Federal Regulation, Appendix B to Part 50. The HVS consists of the following:

- (a) An anodized aluminum shelter;
- (b) A 8"x10" stainless steel filter holder;
- (c) A blower motor assembly;
- (d) A continuous flow/pressure recorder;
- (e) A motor speed-voltage control/elapsed time indicator;
- (f) A 6-day mechanical timer, and
- (g) A power supply of 220v/50 Hz

The HVS is operated and calibrated on a regular basis following the manufacturer's instruction using the NIST-certified standard calibrator brand named TISCH Calibration Kit Model TE-5025A. Regular HVS operation and maintenance as well as filter paper installation and collection is performed by the ET's competent technicians, whereas

laboratory analyses are conducted in a local HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (herein after 'ALS'). The 24-hour TSP filters of the 24-hour TSP will be kept in ALS for six months prior to disposal.

All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper are recorded in details.

2.4.3 Construction Noise

Monitoring Equipment

A list of construction noise monitoring equipment is shown below.

Table 2-4-3 Construction Noise Monitoring Equipment

Equipment	Model	Serial Number
Integrating Sound Level Meter	Bruel & Kjaer 2238	2285721
Calibrator	Bruel & Kjaer 4231	2326408
Portable Wind Speed Indicator	Testo Anemometer	-

Monitoring Procedure

Sound level meters listed above comply with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications, as recommended in Technical Memorandum (TM) issued under the Noise Control Ordinance (NCO).

All noise measurements will be performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level (Leq). Leq(30 min) in six consecutive Leq(5 min) measurements will be used as the monitoring parameter for the time period between 0700-1900 hours on weekdays throughout the construction period. Leq(15min) in three consecutive Leq(5 min) measurements for other time periods (e.g. during restricted hours) will only be conducted for monitoring the construction noise during restricted hours as necessary.

The sound level meter is mounted on a tripod at a height of 1.2 m and placed at the assessment point and oriented such that the microphone is pointed to the site with the microphone facing perpendicular to the line of sight. The windshield is fitted for all measurements. Where a measurement is to be carried out at a building, the assessment point is normally at a position 1 m from the exterior of the building façade. Where a measurement is to be made for noise being received at a place other than a building, the assessment point is at a position 1.2 m above the ground in a free-field situation, i.e. at least 3.5 m away from reflective surfaces such as adjacent buildings or walls.

Immediately prior to and following each noise measurement the accuracy of the sound level meter is checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements will be accepted as valid only if the calibration levels from before and after the noise measurement agree to within 1.0dB. No noise measurement will be made in the present of significant fog, rain, wind with a steady speed exceeding 5m/s or wind with gusts exceeding 10m/s. The wind speed is checked with a portable wind speed meter capable of measuring the wind speed in m/s.

2.4.4 Water Quality

Monitoring Equipment

Monitoring Equipment for water quality is listed below.

Table 2-4-4 Water Quality Monitoring Equipment

Equipment	Model	Serial Number
Water Depth Detector	Eagle Sonar	-
Water Sampler	Teflon bailer / bucket	-
Thermometer & DO meter	YSI 550A	97F0837AM
pH meter	Extech pH Meter EC500 (ALS Lab ID: HK1016226)	-
Turbidimeter	Hach 2100p	08070C031408
Hand Refractometer	ATAGO	289468
Sample Container	High density polythene bottles (provided by laboratory)	-
Storage Container	'Willow' 33-litter plastic cool box	-

Monitoring Procedure

Water Depth

As the water columns in the stream water within KT13 is generally less than 3 m, measurement is performed at the mid-depths of the monitoring locations. In case the water columns are deeper than 6 m, measurement shall be carried out at three water depths, namely, 1 m below water surface, mid-depth, and 1 m above river bed. If the water depths are between 3 to 6 m, the mid-depth measurement is omitted.

Water depths are determined prior to measurement and sampling, using a portable battery operated depth detector, brand named 'Eagle Sonar', if the depths exceed 1.5 meter. For the depths well below 1 meter, the depths of water columns are measured with a steel ruler with appropriate weight.

Dissolved Oxygen (DO)

A portable YSI 550A DO Meter will be used for in-situ DO measurement. The DO meter is capable of measuring DO in the range of 0 - 20 mg/L and 0 - 200 % saturation and checked against water saturated ambient air on each monitoring day prior to monitoring. Although the DO Meter automatically compensates ambient water temperature to a standard temperature of 20°C for ease of comparison of the data under the changing reality, the temperature readings of the DO Meter will be recorded in the field data sheets. Calibration of the equipment will be performed by ALS on quarterly basis.

pH

A portable Extech pH Meter will be used for in-situ pH measurement. The pH meter is capable of measuring pH in the range of 0 – 14 and readable to 0.1. Standard buffer solutions of pH 7 and pH 10 are used for calibration of the instrument before and after measurement. Quarterly calibration of the equipment will be performed by ALS.

Turbidity

A portable Hach 2100p turbidity Meter will be used for in-situ turbidity measurement. The turbidity meter is capable of measuring turbidity in the range of 0 – 1000 NTU. Calibration of the equipment will be performed by ALS on quarterly basis.

Salinity

A portable hand Refractometer AGATO will be used for in-situ salinity measurement. The refractometer is capable of measuring salinity in the range of 0-70ppt with accuracy ±1% reading. Calibration of the equipment will be performed by ALS on quarterly basis.

Suspended Solids (SS)

SS will be determined by ALS upon receipt of the water samples using the HOKLAS accredited analytical method - ALS Method EA-025.

Ammonia Nitrogen(NH₃-N)

NH₃-N will be examined by ALS upon receipt of the water samples using the HOKLAS accredited analytical methods - ALS Method EK-055A.

Zinc(Zn)

Zn will be analyzed by ALS upon receipt of the water samples using the HOKLAS accredited analytical methods - ALS Method EG-020.

Water Sampler

Water samples will be collected using a plastic sampler to prevent metal contamination. As the water depths in the stream water within KT13 are generally less than 0.5 m, a plastic bucket with a rope of appropriate length is used for water sampling. The sampler is rinsed before collection with the sample to be taken. For water depths deeper than 0.5 meter, a cleaned plastic bailer bucket will be used for sample collection.

1000 mL water sample is collected from each depth for SS determination. The samples collected are stored in a cool box maintained at 4⁰C and delivered to ALS upon completion of the sampling by end of each sampling day.

Sample Container

Water samples are contained in screw-cap PE (Poly-Ethylene) bottles, which are provided and pretreated according to corresponding HOKLAS and ALS analytical requirements. Where appropriate, the sampling bottles are rinsed with the water to be contained. Water samples are then transferred from the water sampler to the sampling bottles to 95% bottle capacity to allow possible volume expansion during delivery and storage.

Sample Storage

A 'Willow' 33-litter plastic cool box packed with ice will be used to preserve the collected water samples prior to arrival at ALS. The water temperature of the cool box will be maintained at a temperature as close to 4⁰C as possible without being frozen. Samples collected will be delivered to the laboratory upon collection within the maximum storage time required under the HOKLAS and ALS analytical requirements

2.4.5 Ecology

Monthly walk through survey will be conducted along the boundary of work area for KT13. Bird monitoring will be conducted in the study areas monthly for KT13. Monitoring on the Ho Pui egretty and Ma On Kong egretty will be conducted between March to August. Flight line surveys to record the feeding areas and the habitat use of breeding egrets will be conducted between April to June. Photographic record should be made at six month intervals.

Monitoring Equipment

The following equipment will be used for monitoring:-

Standard portable field survey equipment was used for ecological monitoring, including

- (a) Binoculars of 10 x 40 magnifications;
- (b) Digital camera; and
- (c) Notebook.

Study Area

The areas for the ecological monitoring programme would cover 60 m on either side of the existing channel as well as the proposed bypass culvert, as shown in Figure 6.1 of the EM&A Manual. Within these, emphasis will be given to the area around the Ho Pui and Ma On Kong egrettries and habitats of at least moderate ecological value. In addition, monitoring would also be undertaken at the Ho Pui egretty and Ma On Kong egretty (The Ma On Kong egretty is outside the demarcated monitoring area but is also monitored to identify any adverse effects on the breeding egrets).

Survey Method

Monthly monitoring will be conducted by means of walk through survey, along the

boundary of work area for KT13. Any adverse impacts to the habitats outside the site, in particular the Conservation Area (CA) zone and Ho Pui Egret, will be checked and reported.

Photographic records will be made every six months on the fixed photo record points selected during the baseline survey. The photos from the construction phase ecological monitoring will be compared with those taken during the baseline, which are used as the baseline conditions.

Bird monitoring will be conducted in the study areas monthly for KT13. Attention should be paid on wetland species and species identified as being of conservation importance, and the habitats utilized should also be recorded. Bird surveys should commence no later than 2 hours after dawn.

Monitoring on the Ho Pui egret and Ma On Kong egret will be conducted between March to August. The frequency would be twice per month during March to May. Depending upon the nesting conditions at Ho Pui egret, the frequency could be reduced to monthly between June and August if no egret nest found by the end of May, or maintained at twice per month till the end of August if there are egret nests. Number of active nests, species and number of birds present and breeding stage should be recorded.

Flight line surveys to record the feeding areas and the habitat use of breeding egrets will be conducted twice per month between April to June. The number and species of flying egrets, and their landing habitats and locations should be recorded.

2.4.6 Waste Management, Cultural Heritage and Landscape & Visual

Waste Management, Cultural Heritage and Landscape & Visual monitoring is required for KT13 as stipulated in the EM&A manual [382047/E/EMA/Issue 5] **Section 5**, **Section 7** and **Section 8** accordingly.

Waste Management

During the monthly audit, ETL will pay attention to the issues relating to waste management, and check whether the Contractor has followed the relevant contract Specifications and the procedures specified under the law of HKSAR.

Cultural Heritage

Condition survey by a qualified archaeologist is required for the historical grave near Ma On Kong before and during the construction phase. The method statement of condition survey of Ma On Kong Historic Grave (KT13-02-02) was issued to EPD and endorsed on 27 July 2008, the frequency of the condition survey during the construction phase and given the open cut method would be adopted for the construction of the proposed bypass box culvert under KT13 project, subject to the result of the condition survey carried out before the construction stage, it is recommended that bi-monthly condition survey be undertaken during the construction work within 100m area from the grave.

Landscape and Visual

In accordance with the EM&A manual [382047/E/EMA/Issue5] **Section 8** landscape and visual mitigation measures are required during construction and operation phase. Site inspection will be undertaken at least once every two weeks throughout the construction period to ensure compliance with the intended aims of the proposed mitigation measures.

2.5 QUALITY ASSURANCE PROCEDURES AND DATA MANAGEMENT

2.5.1 Documentation of the Environmental Monitoring

Field data including in-situ monitoring results, weather conditions and water sampling information and observation will be recorded in corresponding Field Data Sheets, which will be signed and dated by the respective environmental technician prior to submission to the ETL for validation and endorsement at the end of the monitoring day.

2.5.2 Data Management and Analysis

All impact monitoring data will be processed by the AUES data recording and management system, which complies with in-house Quality (*ISO 9001:2000*) Management System. Monitoring results recorded in the monitoring equipment e.g. 1-hour TSP Meters and Noise Meters will be downloaded directly from the equipment at the end of the monitoring period and input into a computerized database maintained by the ET. Laboratory results will be input directly into the computerized database and checked by personnel other than those who input the data.

2.5.3 Quality Assurance Procedures

Appropriate and standard QA/QC measures will be adopted for the environmental monitoring to ensure the scientific integrity of the data produced. Sources of error in the impact monitoring will be properly controlled with the following QA/QC procedures:

- (a) Appropriate field monitoring and sampling techniques, including monitoring equipment, storage and delivery of samples;
- (b) Well organized systematic field-data system e.g. all baseline monitoring information, field observation, results, weather conditions and water sampling information, etc. will be recorded in the field monitoring record sheets. The laboratory analysis records will be maintained by the HOKLAS following HOKLAS requirements;
- (c) HOKLAS requirements for QA/QC of all laboratory testing to ensure acceptable accuracy and reproducibility of the laboratory analysis indicated by consistent agreement between duplicate samples, validity of the analytical results by compliance with the required blanks and recovery of standard addition.

2.5.4 Records

All impact monitoring data will be clearly and systematically documented in both hardware and software format and the software copy will be available for inspection upon request. All the document and data will be kept for at least one year after completion of the Project. Field Data Sheets used to record the impact monitoring information, field observation, results, weather conditions and water sampling information, etc., will be properly maintained and kept by the ET. The copies of laboratory analysis records from ALS will be kept by the ET throughout the at least one year after completion of the EM&A program of the Project.

2.6 REPORTING

2.6.1 General Requirements for Report Submission

General requirements for Monthly EM&A report submission as stipulated in the EIA, EP and EM&A Manual are summarized below.

Table 2-6 Requirements for Report Submission

Report	Submission
Monthly EM&A Report	<ul style="list-style-type: none"> • Within 10 working days of the end of each reporting month.
Quarterly EM&A Summary Report	<ul style="list-style-type: none"> • No specific requirement, proposed three weeks after endorsement of the 3rd monthly EM&A report within a particular quarter.
Final EM&A Summary Report	<ul style="list-style-type: none"> • No specific requirement, proposed one month upon completion of entire EM&A program

2.6.2 Cut-Off Day of the Reporting Month

It was agreed among the ER, IEC, CRBC, ET and EPD that, in order to streamline the EM&A report submission and to cater for the occasional delay in obtaining laboratory analysis results, the cutoff day for each month is the 25th i.e. the first day of each report is the 26th of the last month and the end day, the 25th of that month.

3 MONITORING RESULTS

The environmental monitoring results will be compared against the Action and Limit Levels established based on the baseline monitoring results and statutory criteria. In case the measured data exceed the environmental quality criteria, remedial actions will be triggered according to the Event and Action Plan enclosed in **Appendix F**. The environmental monitoring results are tabulated below and the details of 24-hour TSP data and graphical plots of trends of monitored parameters at key stations over the past four Reporting Periods are presented in **Appendices G** and **H**.

3.1 AIR QUALITY

3.1.1 Action and Limit Levels

According to the Baseline Monitoring Report for KT13, the Action and Limit Levels for 24-hour and 1-hour TSP are established as follows:

Table 3-1-1 Air Quality Action and Limit Levels

Monitoring Station	Action Level ($\mu\text{g}/\text{m}^3$)		Limit Level ($\mu\text{g}/\text{m}^3$)	
	1-hour TSP	24-hour TSP	1-hour TSP	24-hour TSP
KT13(A1(a))	309	144	500	260
KT13(A2)	307	141	500	260

3.1.2 Results

Results of air quality monitoring at the identified locations during the Reporting Period are summarized in **Tables 3-1-3-1** and **3-1-3-2** below.

Table 3-1-2-1 Summary of Air Quality Monitoring Results at KT13-A1(a)

1-hour TSP ($\mu\text{g}/\text{m}^3$)						24-hour TSP ($\mu\text{g}/\text{m}^3$)	
Date	Start Time	1 st hour	2 nd hour	3 rd hour	Average	Date	Results
26-Jun-10	09:37	84	86	82	84	2-Jul-10	16
3-Jul-10	09:37	82	84	86	84	8-Jul-10	40
9-Jul-10	09:31	78	81	75	78	14-Jul-10	29
15-Jul-10	09:49	82	85	79	82	20-Jul-10	23
21-Jul-10	09:27	84	86	81	84		
Average (range)		82 (75-86)				Average (range) 27 (16-40)	

Table 3-1-2-2 Summary of Air Quality Monitoring Results at KT13-A2

1-hour TSP ($\mu\text{g}/\text{m}^3$)						24-hour TSP ($\mu\text{g}/\text{m}^3$)	
Date	Start Time	1 st hour	2 nd hour	3 rd hour	Average	Date	Results
26-Jun-10	09:07	86	89	84	86	2-Jul-10	14
3-Jul-10	09:04	86	89	83	86	8-Jul-10	14
9-Jul-10	09:07	77	79	75	77	14-Jul-10	16
15-Jul-10	09:24	83	86	81	83	20-Jul-10	14
21-Jul-10	09:09	87	89	86	87		
Average (range)		84 (75-89)				Average (range) 15 (14-16)	

3.1.3 Discussion

As shown in **Tables 3-1-2-1** and **3-1-2-2**, 1-hour TSP and 24-hour TSP results fluctuated well below the Action Level. No exceedance of Action or Limit Levels was recorded during the Reporting Period. Neither Notification of Exceedance (hereinafter 'NOE') of air quality criteria or corrective action was required.

3.2 CONSTRUCTION NOISE

3.2.1 Action and Limit Levels

The Action and Limit Levels for construction noise are illustrated in **Table 3-2-1**.

Table 3-2-1 Construction Noise Action and Limit Levels

Time Period	Action Level in dB(A)	Limit Level in dB(A)
0700-1900 hours on normal weekdays	When one documented complaint is received	> 75* dB(A)

Note: * Reduces to 70dB(A) for schools and 65dB(A) during the school examination periods.

3.2.2 Results

Results of construction noise monitoring at the identified locations N1(a), N2(a) and N3 during the Reporting Period are summarized in **Tables 3-2-2-1 to 3-2-2-3**.

The baseline monitoring for N1(a) and N2(a) was performed on the 1st floor of the bedroom of 168-169 Kam Ho Road, Ma On Kong Village and No. 68 Ho Pui Village respectively. The impact noise monitoring, however, was performed on the ground floor of the same house due to denial of access to the 1st floor. The change of noise monitoring from 1st floor to ground floor will negate the need for a 3dB(A) façade correction but will not introduce any significant difference in detection and minimization of the of construction noise impacts, or alteration of the established A/L Levels. The ET has obtained the approval from EPD with consultation with the ER and IEC.

Table 3-2-2-1 Summary of Construction Noise Monitoring Results – N1(a)

Date	Start Time	1 st set Leq5	2 nd set Leq5	3 rd set Leq5	4 th set Leq5	5 th set Leq5	6 th set Leq5	Leq30
26-Jun-10	10:57	64.1	64.9	64.6	64.3	64.7	64.2	64.5
3-Jul-10	11:09	64.7	64.9	65.3	64.8	65.6	65.4	65.1
9-Jul-10	10:57	62.1	61.9	62.4	62.3	62.7	62.6	62.3
15-Jul-10	11:06	64.9	65.7	64.2	64.6	65.3	64.3	64.9
21-Jul-10	11:16	61.1	62.0	61.4	61.7	61.5	61.4	61.5
Limit Level								75

Table 3-2-2-2 Summary of Construction Noise Monitoring Results – N2(a)

Date	Start Time	1 st set Leq5	2 nd set Leq5	3 rd set Leq5	4 th set Leq5	5 th set Leq5	6 th set Leq5	Leq30
26-Jun-10	09:31	64.7	63.9	64.0	64.1	63.7	64.3	64.1
3-Jul-10	09:37	62.7	63.9	63.1	63.4	63.7	63.2	63.4
9-Jul-10	09:27	64.3	63.9	64.7	64.2	64.1	63.7	64.2
15-Jul-10	09:24	63.6	64.2	63.9	64.1	63.7	64.3	64.0
21-Jul-10	09:50	63.4	62.7	62.9	63.6	62.7	62.8	63.0
Limit Level								75

Table 3-2-2-3 Summary of Construction Noise Monitoring Results – N3

Date	Start Time	1 st set Leq5	2 nd set Leq5	3 rd set Leq5	4 th set Leq5	5 th set Leq5	6 th set Leq5	Leq30
26-Jun-10	10:17	67.2	66.4	66.9	67.0	66.3	66.7	66.8
3-Jul-10	10:19	63.4	61.7	61.6	62.4	62.7	62.1	62.4
9-Jul-10	10:17	64.9	65.1	64.8	65.7	65.4	65.2	65.2
15-Jul-10	10:19	67.6	68.4	67.9	67.8	68.2	67.6	67.9
21-Jul-10	10:28	65.2	64.7	64.6	65.1	64.3	64.9	64.8
Limit Level								75

3.2.3 Discussion

As shown in **Tables 3-2-2-1, Table 3-2-2-2 and Table 3-2-2-3**, all the construction noise results fluctuated well below the Limit Level. No exceedance of Limit Level or documented construction complaint was recorded during the Reporting Period. No NOE or corrective action was therefore required. During the course of monitoring, no raining was observed as required in EM&A manual.

3.3 WATER QUALITY

3.3.1 Action and Limit Levels

The Action and Limit Levels for water quality are illustrated in **Table 3-3-1**.

Table 3-3-1 Action and Limit Levels for Water Quality Monitoring

Monitoring Location	DO (mg/L)		Turbidity (NTU)		pH		SS (mg/L)		Ammonia (µg/L)		Zinc (µg/L)	
	Action Level	Limit Level	Action Level	Limit Level	Action Level	Limit Level	Action Level	Limit Level	Action Level	Limit Level	Action Level	Limit Level
W1 (Upstream) Control Station	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
W2 (Downstream) Impact Station	1.04	1.00	36.81	37.16	8.65	8.69	79.0	86.2	16.85	16.89	234.95	266.19
W3(a) (Upstream) Control Station	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
W4 (Upstream) Control Station	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
W5 (Upstream) Control Station	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA
W6 (Downstream) Impact Station	0.93	0.91	27.88	30.02	8.7	8.7	73.40	78.68	51.62	54.56	191.90	201.58

3.3.2 Results

Water quality monitoring results measured at W1, W2, W3(a), W4, W5 and W6 during the Reporting Period are presented in tabulation and graphical plots in **Appendix G**.

3.3.2 Discussion

In this Reporting Period, a total of three (3) Limit Level exceedances were registered at impact station W2 and W6 as shown in **Table 3-3-2**.

Table 3-3-2 Summary of Water Quality Exceedances

Location	Exceedance	DO	Turbidity	pH	SS	NH ₄ ⁺ -N	Zn	Total
W2	Action Level	0	0	0	0	0	0	0
	Limit Level	0	0	0	1	0	0	1
W6	Action Level	0	0	0	0	0	0	0
	Limit Level	0	0	0	2	0	0	2
Total	Action Level	0	0	0	0	0	0	0
	Limit Level	0	0	0	3	0	0	3

DO, Turbidity, Zinc and NH₄⁺-N

No exceedances of Action and Limit Levels of DO, Turbidity, Zinc and NH₄⁺-N were recorded during the Reporting Period. No Notifications of Environmental Quality Limit Exceedances (NOE) or corrective actions were therefore required for these parameters.

pH

pH fluctuated within a range from 7.4 to 8.6, which were all below the Action and Limit Levels of 8.65 and 8.69 for W2 and 8.7 for W6.

and SS and

According to the existing Action/Limit Levels, a total of 3 limit level exceedances in suspended solids were recorded during the Reporting Period as shown in **Table 3-3-2**. NOEs were issued upon confirmation of the monitoring results, and investigation was conducted upon receipt of the information of construction activities and implementation status of mitigation measures provided by CRBC.

According to the information provided by the Contractor, it is advised that no construction work was carried out at downstream of Channel KT13. The Contractor has provided proper mitigation measures such as sand bags and earth bund which isolate the construction area and the natural stream. For exceedance on 28 June, muddy water was observed from upstream river after amber rainstorm. Besides, during the daily site inspection by the Contractor on 7 July 2010, discharge from the vicinity agriculture farm was observed and the water quality throughout the channel was affected. Therefore, it is concluded that the exceedance was not related to the works under the Project.

3.4 ECOLOGY

3.4.1 Action and Limit Levels

The Action and Limit Levels for Construction Ecology Monitoring are shown in **Table 3-4-1** to according with the EM&A manual.

Table 3-4-1 Ecological Action and Limit Levels

Parameters	Action Level	Limit Level
Decrease in number of breeding egrets since previous year	>20%	> 40%

3.4.2 Results

Fifty-three (53) individuals of birds from **twenty (20)** species were recorded during the survey on **24 July 2010**. Among the birds recorded, **nine (9)** individuals of wetland dependent birds (from **3 species**) were recorded. The summary of KT13 ecology bird survey can be referred to **Table 3-4-2**.

It is stated in the EP for KT13 that the monitoring of the Ho Pui egretty shall be carried out during the period from 1st March to 31st August as specified in the EM&A Manual. If no egret nest is found at the egretty during the period from 1st March to 31st May, the Permit Holder can start the construction works within 100m of the ecological buffer area upon obtaining the Director's approval until February in the next year. If egret nests are found during the period from 1st March to 31st August, no construction shall take place within 100m of the ecological buffer area before 1st October.

In addition, it is required in the EM&A manual that biweekly monitoring of the Ho Pui egretty for the period from 1st March to end of May is required. Should no egret nest be found at the Ho Pui egretty by the end of May, monitoring frequency from June to August can be downgraded to monthly.

Previously the monitoring during March 2010 to May 2010 did not record any nest in Ho Pui Egretty, and thus the construction works could be conducted within 100m of the ecological buffer area until February 2011. And the egretty monitoring frequency from June to August this year can be downgraded to Monthly. Monthly egretty surveys on Ho Pui Egretty were conducted on 24 July 2010. No nest was found at the Ho Pui egretty during these surveys. Even though, as there had been no nest recorded at Ho Pui egretty in 2009, the action/limit level for ecology is complied.

Ma On Kong egretty was also surveyed 24 July 2010 to provide reference information on

the breeding. No nest was found at Ma On Kong egretty neither. Flight line surveys are required between April to June which is not required in this reporting month.

During the walk through survey on 24 July 2010, other than the bamboo trees which are within Ho Pui Egretty boundary as shown in the EM&A manual and had been found to be cleared by villagers during site inspection on 11 July 2009, no further adverse impacts on habitats outside the boundary of the works area including the Conservation Area and the remaining Ho Pui Egretty was found.

Photo records of trees are required in six-month interval and it is not required in this reporting month.

Table 3-4-2 Summary of KT13 Ecology Impact Monitoring Bird Survey

Scientific Name	Common Name	Reported in the project profile	Abundance recorded in the present survey (24 July 2010)	Habitat utilized
Birds				
Little Egret	<i>Egretta garzetta</i>	✓	3	Stream
Cattle Egret	<i>Bubulcus ibis</i>	✓		
Chinese Pond Heron	<i>Ardeola bacchus</i>	✓	2	Stream
Crested Serpent Eagle	<i>Spilornis cheela</i>	✓		
Bonelli's Eagle	<i>Hieraaetus fasciatus</i>	✓		
Eurasian Hobby	<i>Falco subbuteo</i>	✓		
White-breasted Waterhen	<i>Amaunornis phoenicurus</i>	✓	4	Stream
Spotted Dove	<i>Streptopelia chinensis</i>	✓	3	Bare ground
Common Koel	<i>Eudynamis scolopacea</i>	✓		
Greater Coucal	<i>Centropus sinensis</i>	✓		
Little Swift	<i>Apus affinis</i>	✓		
White-Throated Kingfisher	<i>Halcyon smyrnensis</i>	✓		
Barn Swallow	<i>Hirundo rustica</i>	✓	6	Bare ground
Red-Whiskered Bulbul	<i>Pycnonotus jocosus</i>	✓	2	Bare ground
Chinese Bulbul	<i>Pycnonotus sinensis</i>	✓	3	Woodland, bare ground
Long-Tailed Shrike	<i>Lanius schach</i>	✓	2	Bare ground
Oriental Magpie Robin	<i>Copsychus saularis</i>	✓	3	Bare ground/stream
Masked Laughingthrush	<i>Garrulax perspicillatus</i>	✓	2	Woodland
Yellow-Bellied Prinia	<i>Prinia flaviventris</i>	✓	1	Low lyung grassland
Common Tailorbird	<i>Orthotomus sutorius</i>	✓		
Great Tit	<i>Parus major</i>	✓	2	Woodland
Japanese White-Eye	<i>Zosterops japonicus</i>	✓		
White-Rumped Munia	<i>Lonchura striata</i>	✓		
Eurasian Tree Sparrow	<i>Passer montanus</i>	✓	4	Bare ground, lying grassland
Black-Collared Starling	<i>Sturnus nigricollis</i>	✓	2	Bare ground,
Common Myna	<i>Acridotheres tristis</i>	✓		
Crested Myna	<i>Acridotheres cristatellus</i>	✓	4	Bare ground/ woodland
Black Kite	<i>Milvus migrans</i>	\	1	Woodland
White Wagtail	<i>Motacilla alba</i>	\	3	Stream
Plain Prinia	<i>Prinia inornata</i>	\	1	Low lyung grassland
Common Mapie	<i>Pica pica</i>	\	2	Woodland
White shoulder Starling	<i>Sturnus sinensis</i>	\	3	Bare ground
Species Number		27	20	
Individual Number		NA	53	

*Wetland dependent species recorded with abundance during the baseline study with the names bolded

3.5 WASTE MANAGEMENT, CULTURAL HERITAGE AND LANDSCAPE & VISUAL

3.5.1 Waste Management

In order to comply with the waste management requirements, CRBC has been:

- (a) Assigned, since 9 Jan 2008, a Billing Account (account number 7006524) under the **Waste Disposal (Charges for Disposal of Construction Waste) Regulation**;
- (b) Issued a Discharge License No. 1U461/1 under Section 20 of the **Water Pollution Control Ordinance**;
- (c) Registered as a Chemical Waste Producer under the **Waste Disposal (Chemical Waste) (General) Regulation** (the Waste Producer Number assigned is WPN: 5611-531-C3124-28 dated 2 May 08); and
- (d) Granted by the Environmental Protection Department a Permit Issued under the **Dumping at Sea Ordinance** (Permit no. EP/I4D/08-095, dated 18 September 2008, permit validity period of six months from 18 September 2008 to 17 March 2009) for 18,469 m³ sediment requiring Type 1 – open sea disposal at East Sha Chau Contaminated Mud Disposal Site – Pit IV b to be capped as directed by the management Team of the CEDD.

3.5.2 Cultural Heritage

The Action and Limit Levels for Cultural Heritage are shown in **Table 3-5-2** according to the EM&A Manual.

Table 3-5-2 Cultural Heritage Resources Action and Limit Levels

Action Level	Limit Level
When damage or structural instability is first detected	Signs of deterioration and structural instability continues on subsequent visits after Action Level is triggered

The historical grave KT13-02-02 was identified during the EIA stage of the project. A pre-construction condition survey report was issued in **July 2008** and already agreed by AMO. The details of the grave could be referred to in a report entitled “*Pre-construction condition survey on July 2008*”.

During the Reporting Period, construction work at Channel KT13 had entered the area within 100m of the cultural heritage site (the grave) since 21 October 2009. To update the condition of the grave, supplementary information of condition survey was undertaken on **31 August 2009** (when no construction activities were carried out within 100m areas from the grave). The monitoring result of the supplementary survey would be adopted as the updated initial reading of the settlement level as agreed by ET and IEC

Under the current EM&A programme and approved monitoring methodology, the condition survey would be conducted by ERM Limited on a bi-monthly basis and the settlement monitoring will be conducted by CRBC, again bi-weekly. Should any exceedance was recorded, the frequency of the settlement monitoring shall be increased to weekly and the condition survey shall be increased to bi-weekly. In the settlement monitoring, five settlement marker points (13GS01 to 13GS05) were established to record the coordinates and elevation of the grave in order to monitor any ground movement or settlement during the construction works.

In this reporting period, weekly settlement monitoring was taken on **29 June, 9, 16 and 21 July 2010** to compare with the initial readings to determine if there is any significant tilting or settlement of the grave. Monitoring result demonstrated no exceedance was triggered and the settlement monitoring results are shown in **Table 3-5-3**. The last condition survey was carried out in June and the next survey will be conducted in August 2010

Table 3-5-3 Record of Five Settlement Marker Points of the Qing Dynasty Grave

Monitoring Point Date	Level (mpd)	Diff. (mm)	Level (mpd)	Diff. (mm)	Level (mpd)	Diff. (mm)	Level (mpd)	Diff. (mm)	Level (mpd)	Diff. (mm)
	13GS01		13GS02		13GS03		13GS04		13GS05	
31/08/09 (Initial reading)	19.222	0	19.985	0	20.644	0	19.943	0	19.211	0
29/06/10	19.222	0	19.986	+1	20.644	0	19.944	+1	19.211	0
09/07/10	19.223	+1	19.985	0	20.645	+1	19.944	+1	19.211	0
16/07/10	19.223	+1	19.986	+1	20.644	0	19.943	0	19.211	0
21/07/10	19.222	0	19.986	+1	20.644	0	19.943	0	19.211	0
Breach of A/L Level	-		-		-		-		-	

Note: Action level exceedance would be triggered when the settlement difference is ± 2 mm.

Limit level exceedance would be triggered when the settlement difference is ± 5 mm.

3.5.3 Landscape and Visual

Landscape and visual inspections were conducted on **6 and 19 July 2010**. Current situation of the identified landscape resources remained the same as those of the baseline, except minor changes of river/stream/fish pond landscape character area at LR1, LR2.1, LR2.2, LCA1, LCA3 and LCA4 due to site clearance, soil stockpiling and preparation work within KT13. Updated landscape and visual status is presented in **Appendix J**.

4 NON-COMPLIANCE, COMPLAINT, NOTIFICATION OF SUMMONS, SUCCESSFUL PROSECUTION AND OTHERS

4.1 NON-COMPLIANCE

3 Limit Level exceedances in water quality monitoring were recorded but it concluded that all the exceedances were not project related in this reporting month as discussed in **Section 3.1** to **3.5**. No other non-compliance or deficiency was identified during regular site inspection and environmental audit. No associated remedial action was necessary.

4.2 ENVIRONMENTAL COMPLAINT

No written or verbal complaint was received for each environmental issue during the Reporting Period. No associated remedial action was necessary.

4.3 NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTION

No notifications of summons and successful prosecutions were recorded during the Reporting Period. No associated remedial action was necessary.

4.4 OTHERS

4.4.1 Waste Management Status

All types of waste arising from the construction work are classified into the following:

- Construction & Demolition (C&D) Material;
- Chemical Waste;
- General Refuse; and
- Excavated Soil and sediment

Waste generated, re-used, recycled and disposed of during the Reporting Period is shown in **Appendix K: Monthly Summary Waste Flow Table**. No Type I or Type II excavated soil were recorded in this Reporting Period.

4.4.2 Site Inspection and Environmental Audit

In this Reporting Period, **four** occasions of weekly environmental site inspection and audit were conducted during the Reporting Period jointly by the ER, EO and ET. No adverse environmental impacts were registered, indicating that the mitigation measures implemented were effective and sufficient for the construction activities undertaken. Minor deficiencies found in the site inspection and audit were in general rectified within the specified deadlines. Findings of the site inspection and environmental audit are summarized below.

Table 4-4-1 Summary of Findings of Site Inspection and Environmental Audit

Date	Findings / Deficiencies	Follow-Up Status
30 June 2010	The Contractor is reminded for the maintenance of soil bund after heavy rain.	Recommendations based on the observation on 6 July 2010 were followed.
6 July 2010	The Contractor is reminded to increase the water spraying frequency under very hot weather.	Recommendations based on the observation on 13 July 2010 were followed.
13 July 2010	The Contractor is reminded for the housekeeping of stockpiled materials.	Recommendations based on the observation on 22 July 2010 were followed.
22 July 2010	The Contractor is advised to increase the height of sandbags for minimizing wheel-washing wastewater to nearby stream.	Will be reported in next reporting month.

4.4.3 Works to be Undertaken Next Month

Works to be undertaken next month are shown in the construction program enclosed in **Appendix B**. The construction activities undertaken in the Reporting Period including:

- Excavation of channel formation
- Construction of channel structure
- Backfilling
- Installation of type 2 railing
- Laying underground drain pipe
- Laying of Gabion Block/Granite Block

4.4.4 Future Key Issues and Mitigation Measures for the Forth-Coming Month

During wet season, water quality mitigation measures to avoid ingress of runoff into Channel KT13 should be properly installed and maintained, as appropriate. It is reminded the sand bund at the channel should be regular repaired to cater the high flow of water.


In addition, special attention should also be paid to air quality, construction noise, ecology and other environmental issues identified in the EM&A Manual. Mitigation measures recommended in the EIA and summarized in Mitigation Measure Implementation Schedule (EMIS) should be fully implemented.

5 CONCLUSIONS AND RECOMMENDATIONS

- i) This is the **22nd** monthly EM&A report for Channel KT13, covering the construction period from **26 June to 25 July 2010** (the Reporting Period).
- ii) Monitoring results of the Reporting Period demonstrated no exceedances of environmental quality criteria for air quality and construction noise monitoring.
- iii) For stream water quality monitoring, a total of 3 Limit level exceedances in suspended solids were recorded at impact station W2 and W6. Investigation concluded that the exceedances were not project related.
- iv) Monthly Ho Pui egretry survey and Ma On Kong egretry survey was conducted on 24 July 2010. In comparing the monitoring result in 2009, no exceedance was recorded in this reporting month.
- v) Four (4) events of weekly settlement monitoring for the historic grave were undertaken in this reporting month. The monitoring results demonstrated no exceedances recorded in both surveys.
- vi) Landscape inspections were conducted on **6 and 19 July 2010**. No significant changes were observed for identified landscape resources and visual sensitive receivers, except for minor changes due to channel excavation, site clearance and preparation work at the identified landscape resources including LR1, LR2.1, LR2.2, LCA1, LCA3 and LCA4.
- vii) No documented complaints, notifications of summons or successful prosecutions were received during the Reporting Period. No adverse environmental impacts were observed during the weekly site inspection and environmental audit of the Reporting Period, which suggested that the implemented mitigation measures for air quality, construction noise and ecology were effective. Minor deficiencies found in the weekly site inspection were in general rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- viii) During wet season, it was reminded that water quality mitigation measures stipulated in the EIA and summarized in mitigation measures implementation schedule in the EM&A Manual, including containment structure such as temporary earth bunds, sand bags, sheet pile barriers or other similar techniques, be fully implemented.

END OF TEXT

Appendix A
Location Plan and
Environmental Monitoring Locations
Under the Project

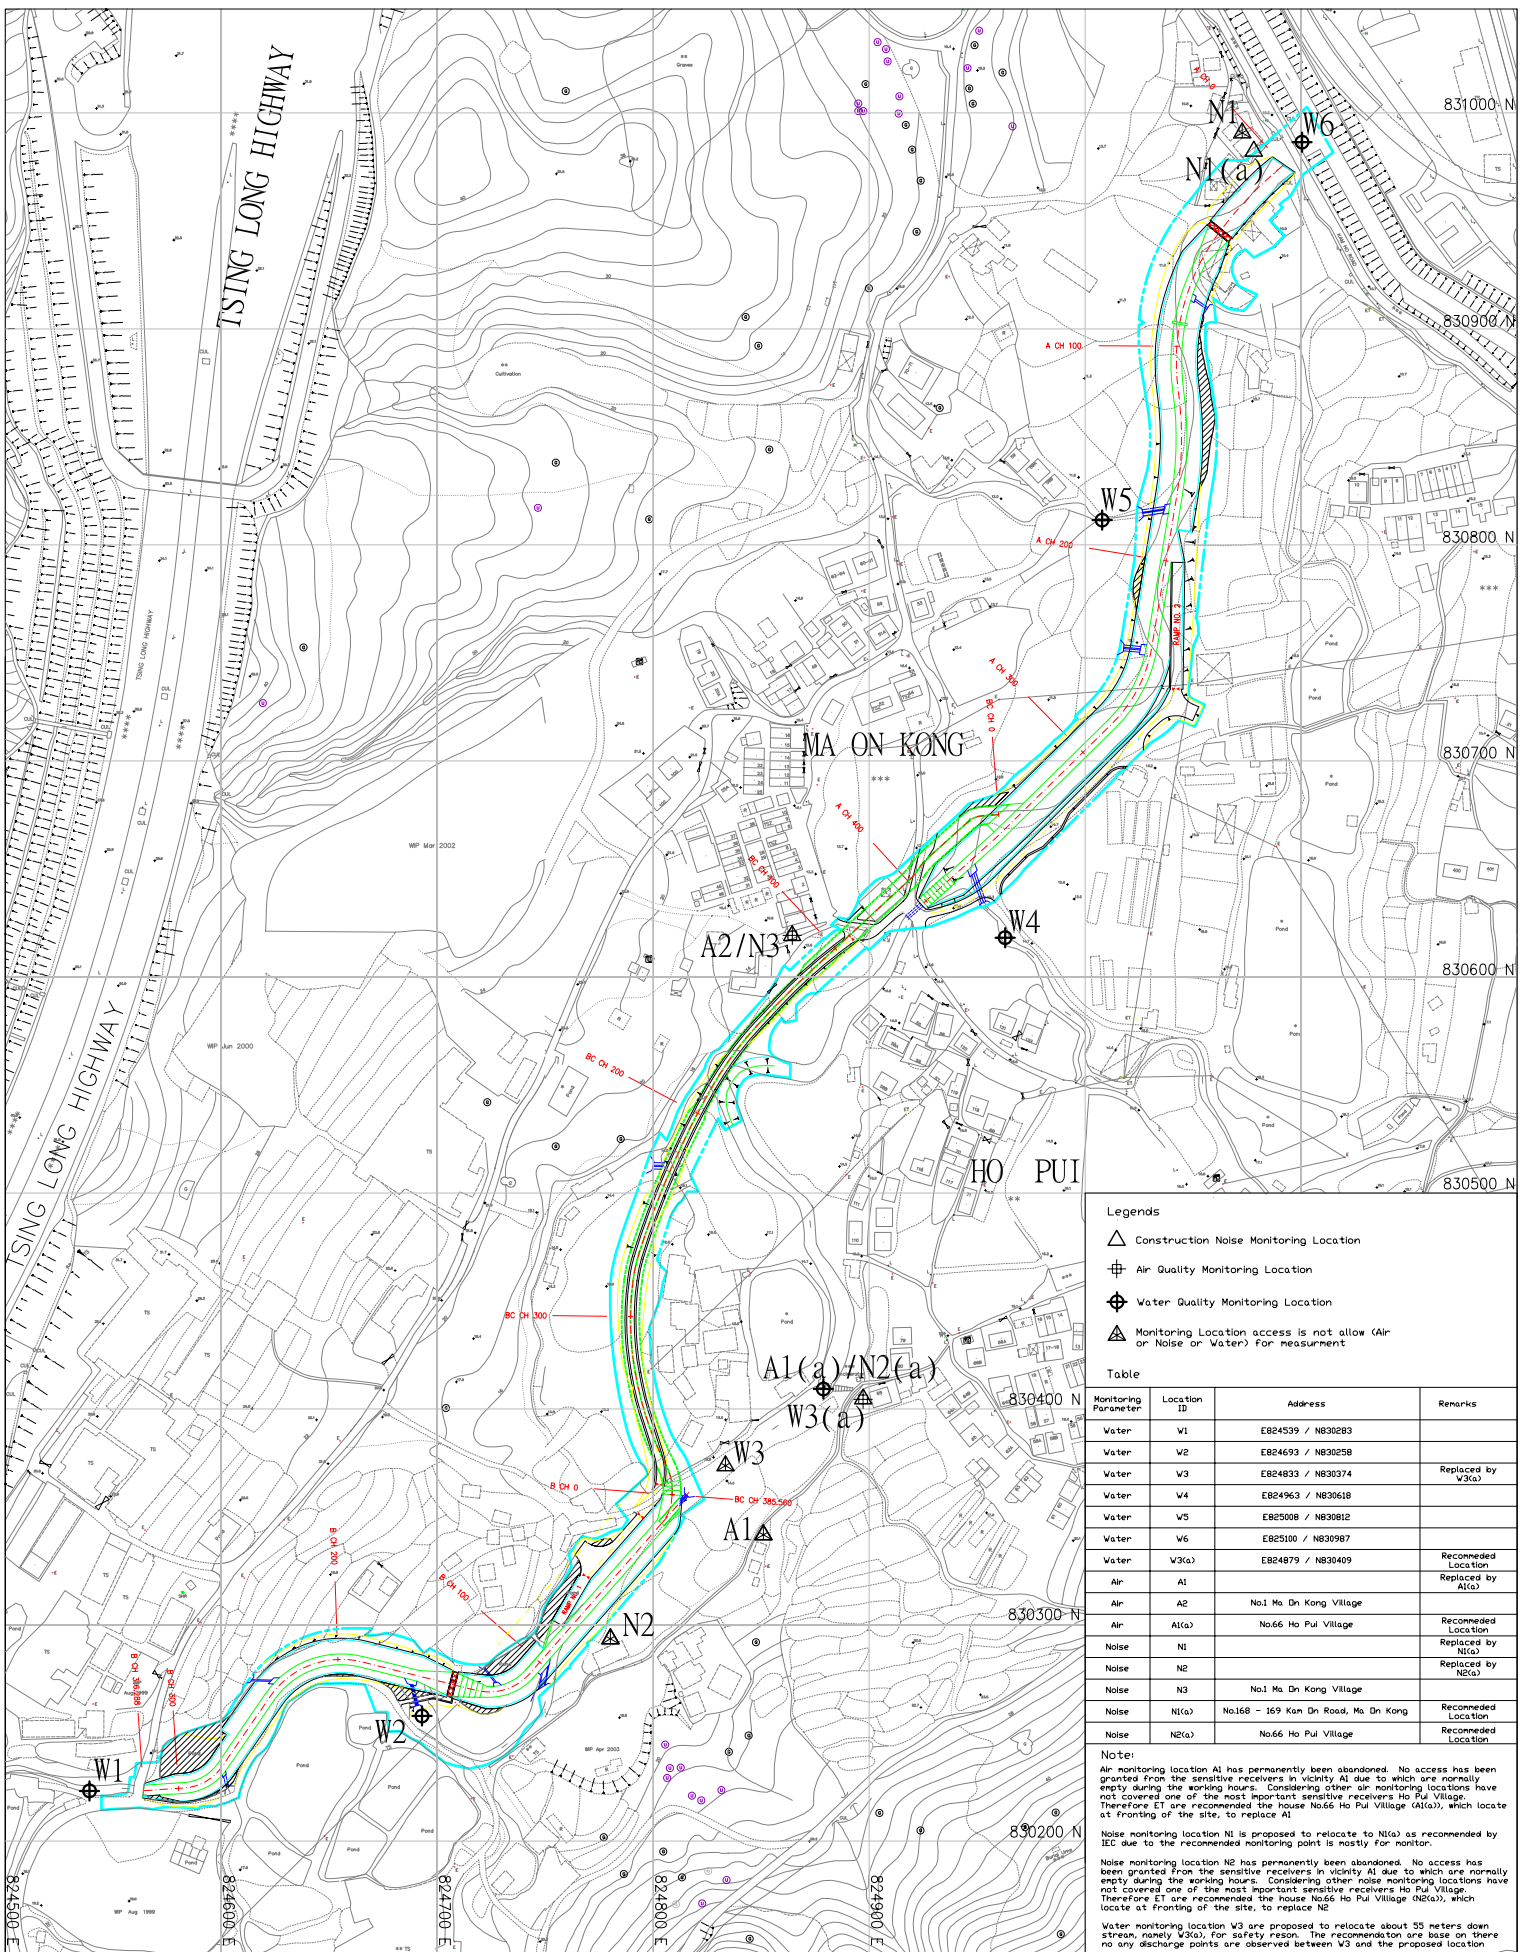

- Legends**
- △ Construction Noise Monitoring Location
 - Air Quality Monitoring Location
 - Water Quality Monitoring Location
 - △ Monitoring Location access is not allow (Air or Noise or Water) for measurement

Table

Monitoring Parameter	Location ID	Address	Remarks
Water	W1	E824539 / N830283	
Water	W2	E824693 / N830258	
Water	W3	E824833 / N830374	Replaced by W3(a)
Water	W4	E824963 / N830618	
Water	W5	E825008 / N830812	
Water	W6	E825100 / N830987	
Water	W3(a)	E824879 / N830409	Recommended Location
Air	A1		Replaced by A1(a)
Air	A2	No.1 Ma On Kong Village	
Air	A1(a)	No.66 Ho Pul Village	Recommended Location
Noise	N1		Replaced by N1(a)
Noise	N2		Replaced by N2(a)
Noise	N3	No.1 Ma On Kong Village	
Noise	N1(a)	No.168 - 169 Kan Dn Road, Ma On Kong	Recommended Location
Noise	N2(a)	No.66 Ho Pul Village	Recommended Location

Note:

Air monitoring location A1 has permanently been abandoned. No access has been granted from the sensitive receivers in vicinity A1 due to which are normally empty during the working hours. Considering other air monitoring locations have not covered one of the most important sensitive receivers Ho Pul Village. Therefore ET are recommended the house No.66 Ho Pul Village (A1(a)), which locate at fronting of the site, to replace A1

Noise monitoring location N1 is proposed to relocate to N1(a) as recommended by IEC due to the recommended monitoring point is mostly for monitor.

Noise monitoring location N2 has permanently been abandoned. No access has been granted from the sensitive receivers in vicinity N2 due to which are normally empty during the working hours. Considering other noise monitoring locations have not covered one of the most important sensitive receivers Ho Pul Village. Therefore ET are recommended the house No.66 Ho Pul Village (N2(a)), which locate at fronting of the site, to replace N2

Water monitoring location W3 are proposed to relocate about 55 meters down stream, namely W3(a), for safety reason. The recommendation are base on there no any discharge points are observed between W3 and the proposed location

Drawing:
Air, Noise and Stream Water Monitoring Location at KT-13



Contract No. IC/2007/17-
 Drainage Improvement Works in Cheung Po
 Koi, San Tin, Ma On Kong, Tai Tam and San
 Tin, Tuen Mun, Tuen Mun District and Sewerage
 at Tsing Tau Chung Tsuen, Tuen Mun



Copyright by Black & Veatch Hong Kong Limited and
Corporation of BESAR

NOTES:
1. GRID LINES ARE HONG KONG METRIC GRID 1980.

- LEGEND:
- MA ON KONG AND HO PUT ECRESSES
 - PROPOSED COMPENSATORY TREE PLANTING
 - CONSERVATION AREA DENOED ON OUTLINE ZONING PLAN
 - WORKS BOUNDARY OF CHANNEL XT13
 - ECOLOGY MONITORING AREAS

Revision	Date	Description			Initial
		Designed	Checked	Drawn	
Initial		MC	KIL	YLL	KIL
Date	09/05	09/05	09/05	09/05	09/05

AGREEMENT NO. CE 67/98

Contract title
YUEN LONG, KAM TIN,
NGAU TAM MEI AND TIN SHUI WAI
DRAINAGE IMPROVEMENT, STAGE 1,
PHASE 2B - KAM TIN


Drawing title
ECOLOGY MONITORING AREAS
RECOMMENDED FOR
CONSTRUCTION PHASE AND
OPERATION PHASE

Drawing no.	Scale
Figure 6.1	1:2000 A1 1:4000 A3

香港特別行政區政府渠務署
THE GOVERNMENT OF THE
HONG KONG
SPECIAL ADMINISTRATIVE REGION
DRAINAGE SERVICES DEPARTMENT

BLACK & VEATCH HONG KONG LIMITED
務政工程顧問有限公司

Plot Date: 25. APR. 2006
CAD Filename: p:\d\dr\water\dr\map\12047\c20\env\plan\1210-5.dwg

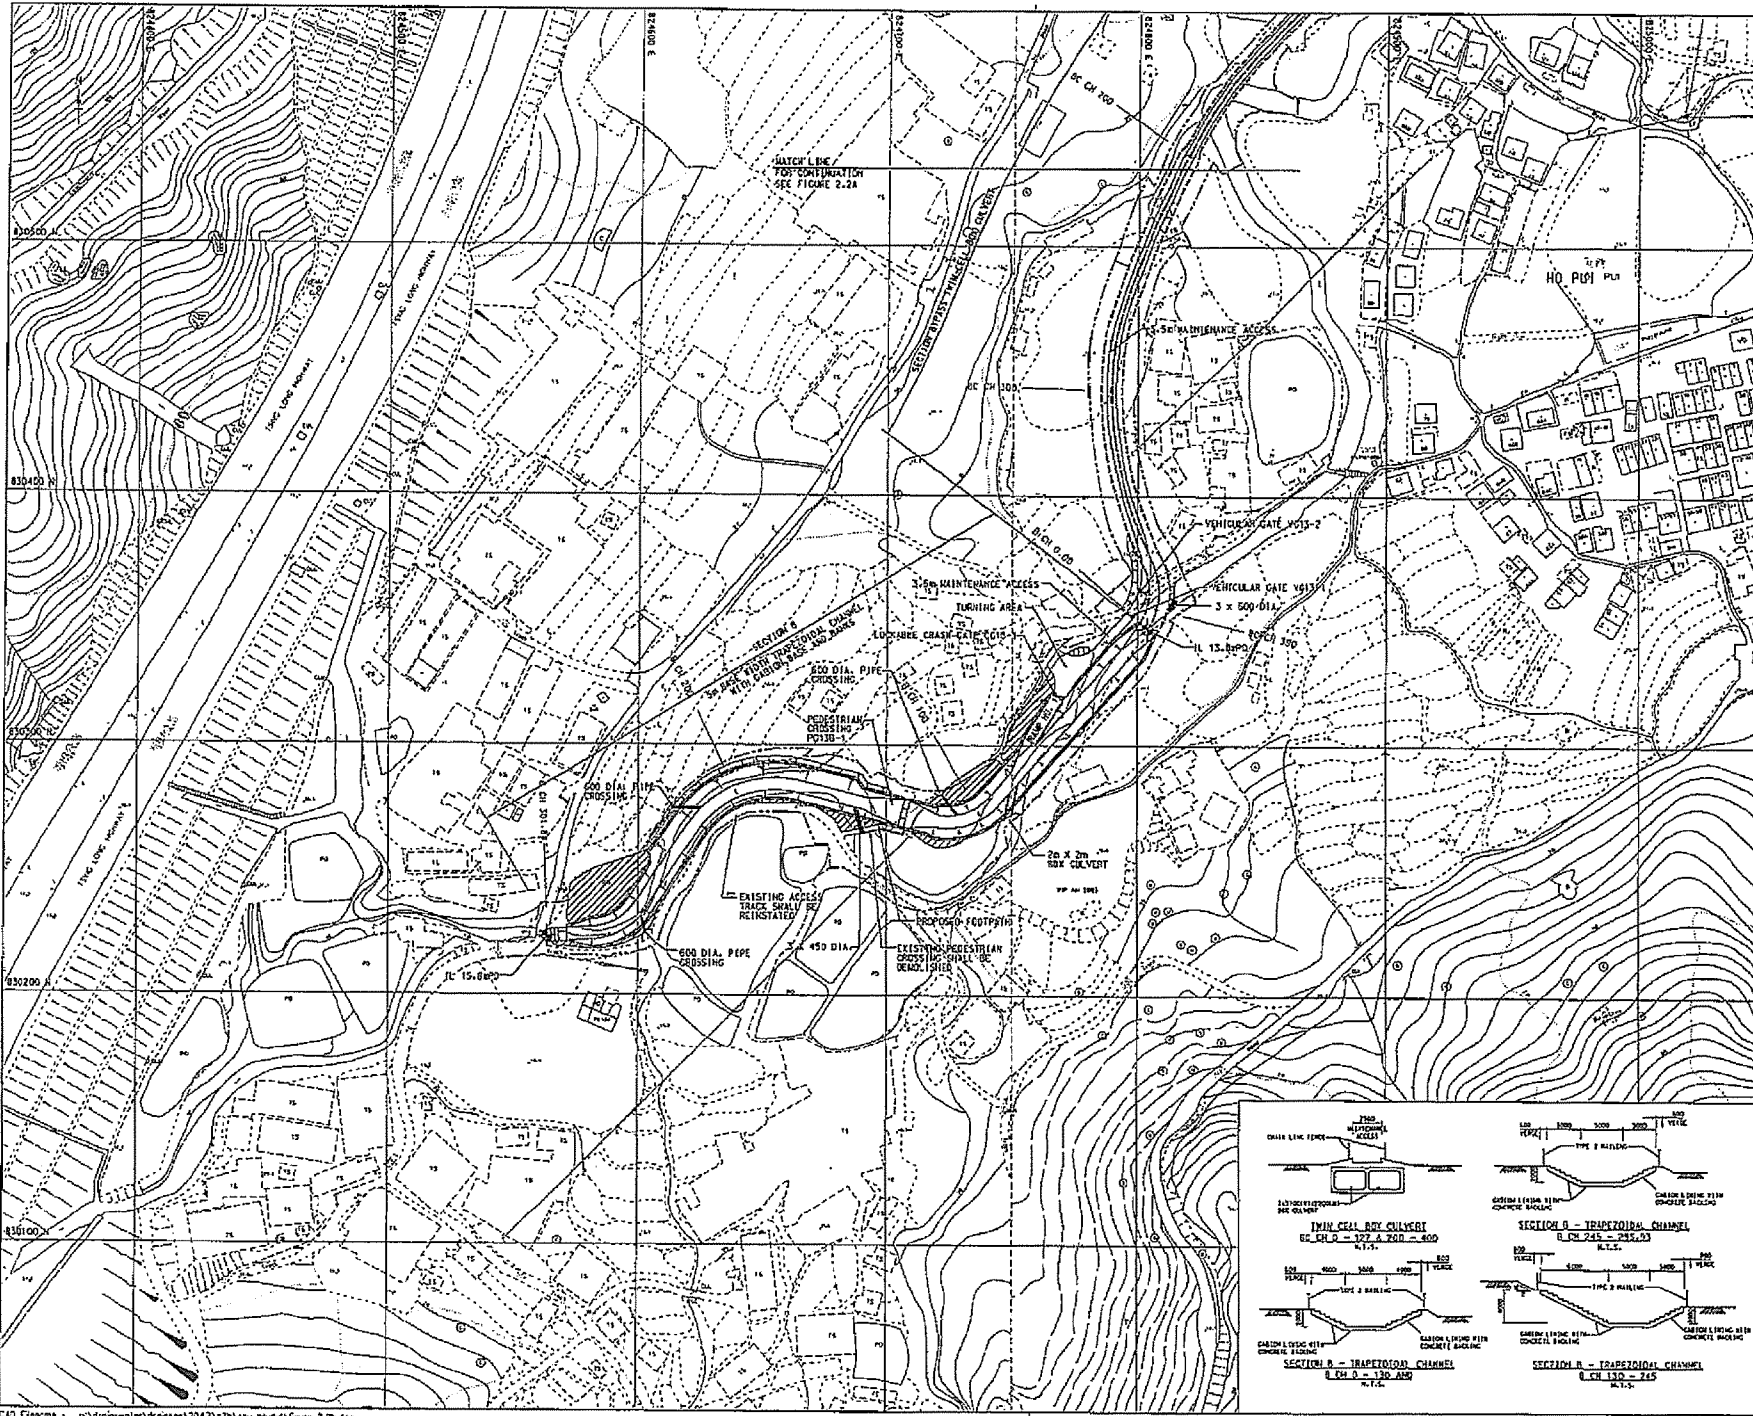

© COPYRIGHT BY BLACK & VEATCH HONG KONG LIMITED and Government of HONG KONG

NOTES:

1. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS STATED OTHERWISE.
2. GRID LINES ARE HONG KONG METRIC GRID 1960.
3. TYPE 2 RAILING WITH DEBRIS TRAP BAR AND BENCH MARK PILES SHALL BE PROVIDED AT BOTH SIDES OF THE CHANNEL BANKS.

LEGEND:

- SITE BOUNDARY
- PROPOSED CHANNEL
- PROPOSED SLOPE
- ▨ AREA TO BE FILLED TO ADJACENT GROUND LEVEL
- I.L. TWENTY LEVEL
- PROPOSED RETAINING WALL

C	05/05	AMENDMENT TO	BY-PASS CULVERT	K.I.L.
B	10/05	MINOR AMENDMENT TO	CHANNEL LAYOUT	K.I.L.
A	05/05	MINOR AMENDMENTS TO	SITE BOUNDARY	K.I.L.

REVISION	DATE	DESCRIPTION	BY	CHECKED	DATE
1					
2					
3					

Author	TY	K.I.L.	AK	X.I.L.
Date	04/04	04/04	04/04	04/04

AGREEMENT NO. CE 62/93


Contract Title:

YUEN LONG, KAM TIN, NGAU TAM MEI AND TIN SHUI WAI DRAINAGE IMPROVEMENT, STAGE 1, PHASE 2B - KAM TIN

MA ON KONG CHANNEL KT13 PROPOSED LAYOUT PLAN (SHEET 2 OF 2)

FIGURE 1.3b

Scale: 1:2000 A1, 1:2000 A3

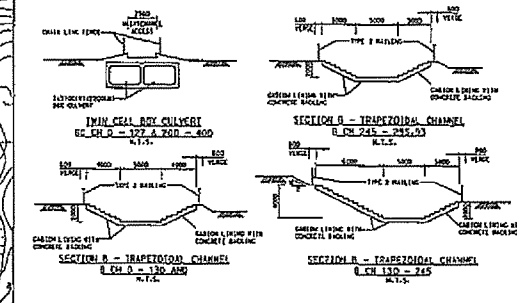


Plot Date: 16 APR 2006

Appendix B

Construction Program

Monthly Rolling Programme - July 2010


Item	Task Name	Duration	Start	Finish	7/2010					
					27/6	4/7	11/7	18/7	25/7	1/8
1	Section II (Channel KT13)	26 days	2010/7/2	2010/7/31	[Summary bar]					
2	Regular Environmental Impact Monitoring	26 days	2010/7/2	2010/7/31	[Progress bar]					
3	Regular Tree Survey & Protection	26 days	2010/7/2	2010/7/31	[Progress bar]					
4	Regular Structural Condition Survey	26 days	2010/7/2	2010/7/31	[Progress bar]					
5	Section A	26 days	2010/7/2	2010/7/31	[Summary bar]					
6	Construction of Retaining Wall and Channel (A CH0.00 - A CH402.00)	20 days	2010/7/5	2010/7/27	[Summary bar]					
7	Construction of channel structure (RC2, Transition, and TG2)	15 days	2010/7/5	2010/7/21	[Summary bar]					
8	Bay RT1 (A CH269.95 - A CH282.43) - Retaining Wall (Remaining Part)	5 days	2010/7/5	2010/7/9	[Task bar]					
9	Bay RT2 (A CH282.43 - A CH294.59) - Retaining Wall (Remaining Part)	5 days	2010/7/10	2010/7/15	[Task bar]					
10	Bay RT3 (A CH294.59 - A CH306.75) - Retaining Wall (Remaining Part)	5 days	2010/7/5	2010/7/9	[Task bar]					
11	Bay RT4 (A CH306.75 - A CH318.91) - Retaining Wall (Remaining Part)	5 days	2010/7/10	2010/7/15	[Task bar]					
12	Bay RT5 (A CH318.91 - A CH331.09) - Retaining Wall (Remaining Part)	5 days	2010/7/16	2010/7/21	[Task bar]					
13	Backfilling along the channel sides / laying underground drain pipe	5 days	2010/7/22	2010/7/27	[Summary bar]					
14	Bay RT1 (A CH269.95 - A CH282.43) - Retaining Wall (Remaining Part)	1 day	2010/7/22	2010/7/22	[Task bar]					
15	Bay RT2 (A CH282.43 - A CH294.59) - Retaining Wall (Remaining Part)	1 day	2010/7/23	2010/7/23	[Task bar]					
16	Bay RT3 (A CH294.59 - A CH306.75) - Retaining Wall (Remaining Part)	1 day	2010/7/24	2010/7/24	[Task bar]					
17	Bay RT4 (A CH306.75 - A CH318.91) - Retaining Wall (Remaining Part)	1 day	2010/7/26	2010/7/26	[Task bar]					
18	Bay RT5 (A CH318.91 - A CH331.09) - Retaining Wall (Remaining Part)	1 day	2010/7/27	2010/7/27	[Task bar]					
19	Installation of Type 2 railing	15 days	2010/7/5	2010/7/21	[Summary bar]					
20	Bay A25 (A CH244.23 - A CH257.09) - TG2 (EB)	3 days	2010/7/5	2010/7/7	[Task bar]					
21	Bay A26 (A CH257.09 - A CH269.95) - TG2 (EB)	2 days	2010/7/8	2010/7/9	[Task bar]					
22	Bay A32 (A CH331.09 - A CH343.21) - Transition	2 days	2010/7/10	2010/7/12	[Task bar]					
23	Bay A33 (A CH343.21 - A CH359.26) - Transition	2 days	2010/7/13	2010/7/14	[Task bar]					
24	Bay A34 (A CH359.26 - A CH374.28) (EB)	2 days	2010/7/15	2010/7/16	[Task bar]					
25	Bay A35 (A CH374.28 - A CH389.29) (EB)	2 days	2010/7/17	2010/7/19	[Task bar]					
26	Bay A36 (A CH389.29 - A CH400.18) (EB)	2 days	2010/7/20	2010/7/21	[Task bar]					
27	Laying gabion block / granite block inside the channel	15 days	2010/7/15	2010/7/31	[Summary bar]					
28	Bay A34 (A CH359.26 - A CH374.28) - Rectangular Channel	3 days	2010/7/15	2010/7/17	[Task bar]					

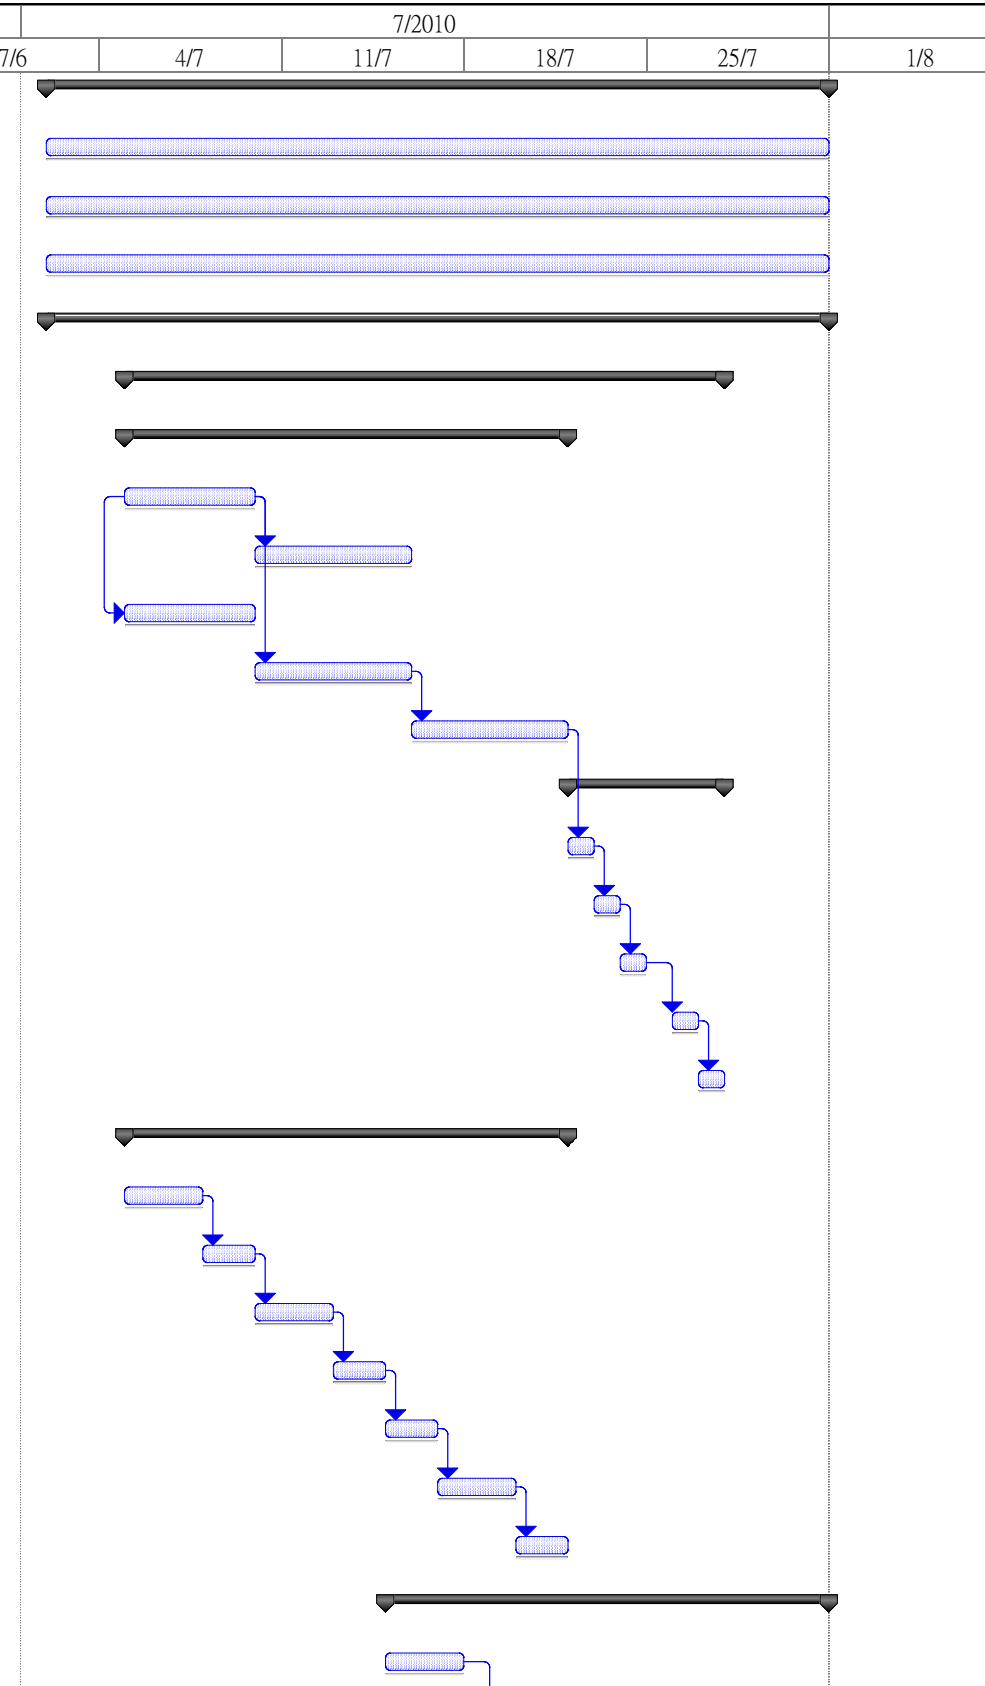

Task Split Progress Milestone Summary

Monthly Rolling Programme - July 2010

Item	Task Name	Duration	Start	Finish	7/2010						
					27/6	4/7	11/7	18/7	25/7	1/8	
29	Bay A31 (A CH318.91 - A CH331.09) - TG6	3 days	2010/7/19	2010/7/21							
30	Bay A30 (A CH306.75 - A CH318.91) - TG6	3 days	2010/7/22	2010/7/24							
31	Bay A29 (A CH294.59 - A CH306.75) - TG6	3 days	2010/7/26	2010/7/28							
32	Bay A28 (A CH282.43 - A CH294.59) - TG6	3 days	2010/7/29	2010/7/31							
33	Construction of catchpit / manhole / drain pipe along the channel sides	26 days	2010/7/2	2010/7/31							
34	Bay A1 - Bay A36	26 days	2010/7/2	2010/7/31							
35	Section of Box Culvert BC13-1	26 days	2010/7/2	2010/7/31							
36	Construct box culvert (BC CH0.00 - BC CH386.00)	26 days	2010/7/2	2010/7/31							
37	Excavation for box culvert formation & laying of rock fill material (BC CH0.00 - BC CH384.00)	26 days	2010/7/2	2010/7/31							
38	Bay BC13 (BC CH170.20 - BC CH155.56)	5 days	2010/7/2	2010/7/7							
39	Bay BC12 (BC CH155.56 - BC CH140.65)	5 days	2010/7/8	2010/7/13							
40	Bay BC6 (BC CH76.57 - BC CH61.97)	5 days	2010/7/8	2010/7/13							
41	Bay BC11 (BC CH140.65 - BC CH126.63)	4 days	2010/7/28	2010/7/31							
42	Bay BC7 (BC CH91.96 - BC CH76.57)	4 days	2010/7/28	2010/7/31							
43	Construction of box culvert	15 days	2010/7/8	2010/7/24							
44	Bay BC13 (BC CH170.20 - BC CH155.56)	10 days	2010/7/8	2010/7/19							
45	Bay BC12 (BC CH155.56 - BC CH140.65)	10 days	2010/7/14	2010/7/24							
46	Bay BC6 (BC CH76.57 - BC CH61.97)	10 days	2010/7/14	2010/7/24							
47	Backfilling the sides of channel structure & Laying of underground drain pipe	7 days	2010/7/20	2010/7/27							
48	Bay BC13 (BC CH170.20 - BC CH155.56)	2 days	2010/7/20	2010/7/21							
49	Bay BC12 (BC CH155.56 - BC CH140.65)	2 days	2010/7/26	2010/7/27							
50	Bay BC6 (BC CH76.57 - BC CH61.97)	2 days	2010/7/26	2010/7/27							
51	Section B	26 days	2010/7/2	2010/7/31							
52	Laying gabion block / granite block inside the channel	26 days	2010/7/2	2010/7/31							
53	Bay B26 (B CH260.00 - B CH270.00) - TG4	4 days	2010/7/2	2010/7/6							
54	Bay B25 (B CH248.00 - B CH260.00) - TG5	4 days	2010/7/7	2010/7/10							
55	Bay B24 (B CH236.00 - B CH248.00) - TG5	4 days	2010/7/12	2010/7/15							
56	Bay B23 (B CH224.00 - B CH236.00) - TG5	4 days	2010/7/16	2010/7/20							

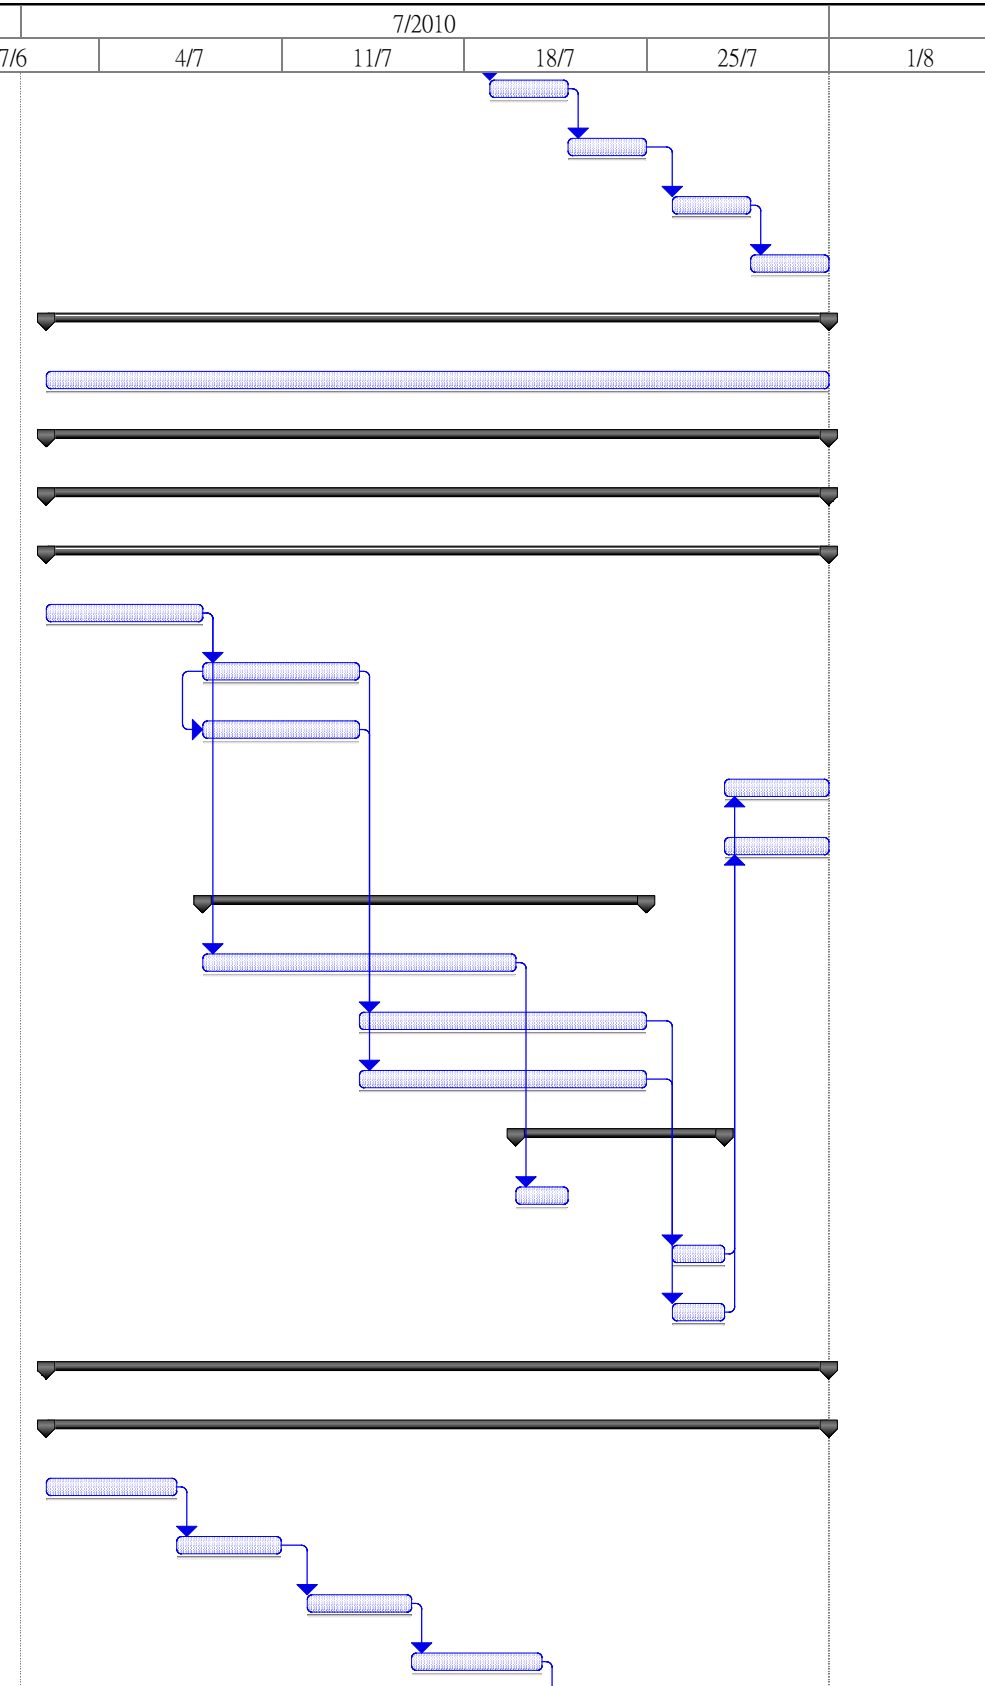

Task Split Progress Milestone Summary

Monthly Rolling Programme - July 2010

Item	Task Name	Duration	Start	Finish	7/2010						
					27/6	4/7	11/7	18/7	25/7	1/8	
57	Bay B22 (B CH212.00 - B CH224.00) - TG5	4 days	2010/7/21	2010/7/24							
58	Bay BC21 (BC CH275.39 - BC CH260.81)	3 days	2010/7/26	2010/7/28							
59	Bay BC20 (BC CH260.81 - BC CH245.97)	3 days	2010/7/29	2010/7/31							
60	Construction of catchpit / manhole / drain pipe along the channel sides	26 days	2010/7/2	2010/7/31							
61	Bay B3 - Bay A30	26 days	2010/7/2	2010/7/31							
62											
63	Section V	26 days	2010/7/2	2010/7/31							
64	Preservation and protection of tree for Section I, II, III and IV	26 days	2010/7/2	2010/7/31							
65											
66	Section VI - Portion 9A & 9B (Tuen Mun Sewerage Work)	26 days	2010/7/2	2010/7/31							
67	Structural Survey and Monitoring	26 days	2010/7/2	2010/7/31							
68	Construction of Manhole, Timber Box and Trench Excavation	26 days	2010/7/2	2010/7/31							
69											
70	Section VII - Portion 10A, 10B & 10C (Tuen Mun Sewerage Work)	26 days	2010/7/2	2010/7/31							
71	Structural Survey and Monitoring	26 days	2010/7/2	2010/7/31							
72	Construction of Manhole, Timber Box and Trench Excavation	26 days	2010/7/2	2010/7/31							

Task Split Progress Milestone Summary

Contract No. : DC/2007/17
 Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen and Tin Sam Tsuen of Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Three Months Rolling Programme - August 2010 to October 2010

ID	Task Name	Duration	Start	Finish	Aug 2010					Sep 2010					Oct 2010				
					25/7	1/8	8/8	15/8	22/8	29/8	5/9	12/9	19/9	26/9	3/10	10/10	17/10	24/10	31/10
1	Section II (Channel KT13)	75 days	2010/8/2	2010/10/30															
2	Regular Environmental Impact Monitoring	75 days	2010/8/2	2010/10/30															
3	Regular Tree Survey & Protection	75 days	2010/8/2	2010/10/30															
4	Regular Structural Condition Survey	75 days	2010/8/2	2010/10/30															
5	Section A	75 days	2010/8/2	2010/10/30															
6	Installation of Type 2 railing	15 days	2010/8/2	2010/8/18															
7	Bay RT1 (A CH269.95 - A CH282.43) - Retaining Wall	3 days	2010/8/2	2010/8/4															
8	Bay RT2 (A CH282.43 - A CH294.59) - Retaining Wall	3 days	2010/8/5	2010/8/7															
9	Bay RT3 (A CH294.59 - A CH306.75) - Retaining Wall	3 days	2010/8/9	2010/8/11															
10	Bay RT4 (A CH306.75 - A CH318.91) - Retaining Wall	3 days	2010/8/12	2010/8/14															
11	Bay RT5 (A CH318.91 - A CH331.09) - Retaining Wall	3 days	2010/8/16	2010/8/18															
12	Laying gabion block / granite block inside the channel	75 days	2010/8/2	2010/10/30															
13	Bay A28 (A CH282.43 - A CH294.59) - TG6	4 days	2010/8/2	2010/8/5															
14	Bay A27 (A CH269.95 - A CH282.43) - TG6	4 days	2010/8/6	2010/8/10															
15	Bay A26 (A CH257.09 - A CH269.95) - TG2	4 days	2010/8/11	2010/8/14															
16	Bay A25 (A CH244.23 - A CH257.09) - TG2	4 days	2010/8/16	2010/8/19															
17	Bay A24 (A CH237.50 - A CH244.23) - TG2	4 days	2010/8/20	2010/8/24															
18	Bay A23 (A CH225.47 - A CH237.50) - TG2	4 days	2010/8/25	2010/8/28															
19	Bay A22 (A CH213.44 - A CH225.47) - TG2	4 days	2010/8/30	2010/9/2															
20	Bay A21 (A CH201.41 - A CH213.44) - TG2	4 days	2010/9/3	2010/9/7															
21	Bay A20 (A CH190.69 - A CH201.41) - TG2	4 days	2010/9/8	2010/9/11															
22	Bay A19 (A CH179.97 - A CH190.69) - TG2	4 days	2010/9/13	2010/9/16															
23	Bay A18 (A CH167.00 - A CH179.97) - TG2	4 days	2010/9/17	2010/9/21															
24	Bay A17 (A CH156.08 - A CH167.00) - TG2 (WB)	3 days	2010/9/22	2010/9/25															
25	Bay A16 (A CH143.92 - A CH156.08) - TG2 (WB)	3 days	2010/9/27	2010/9/29															
26	Bay A15 (A CH131.78 - A CH143.92) - TG2 (WB)	3 days	2010/9/30	2010/10/4															
27	Bay A14 (A CH119.62 - A CH131.78) - TG2 (WB)	3 days	2010/10/5	2010/10/7															
28	Bay A13 (A CH107.46 - A CH119.62) - TG2 (WB)	3 days	2010/10/8	2010/10/11															
29	Bay A12 (A CH96.57 - A CH107.46) - TG2 (WB)	3 days	2010/10/12	2010/10/14															
30	Bay A11 (A CH84.25 - A CH96.57) - TG2 (WB)	3 days	2010/10/15	2010/10/19															
31	Bay A10 (A CH70.69 - A CH84.25) - TG2 (WB)	3 days	2010/10/20	2010/10/22															
32	Bay A9 (A CH58.74 - A CH70.69) - TG2 (WB)	3 days	2010/10/23	2010/10/26															
33	Bay A2 (A CH11.16 - A CH17.28) - RC2	3 days	2010/10/27	2010/10/29															
34	Bay A1 (A CH00.00 - A CH11.16) - RC2	1 day	2010/10/30	2010/10/30															
35	Construction of catchpit / manhole / drain pipe along the channel sides	75 days	2010/8/2	2010/10/30															
36	Bay A17 (A CH156.08 - A CH167.00) - TG2 (EB)	2 days	2010/8/2	2010/8/3															
37	Bay A16 (A CH143.92 - A CH156.08) - TG2 (EB)	2 days	2010/8/4	2010/8/5															
38	Bay A15 (A CH131.78 - A CH143.92) - TG2 (EB)	2 days	2010/8/6	2010/8/7															
39	Bay A14 (A CH119.62 - A CH131.78) - TG2 (EB)	2 days	2010/8/9	2010/8/10															
40	Bay A13 (A CH107.46 - A CH119.62) - TG2 (EB)	2 days	2010/8/11	2010/8/12															
41	Bay A12 (A CH96.57 - A CH107.46) - TG2 (EB)	2 days	2010/8/13	2010/8/14															
42	Bay A11 (A CH84.25 - A CH96.57) - TG2 (EB)	2 days	2010/8/16	2010/8/17															
43	Bay A10 (A CH70.69 - A CH84.25) - TG2 (EB)	2 days	2010/8/18	2010/8/19															
44	Bay A9 (A CH58.74 - A CH70.69) - TG2 (EB)	2 days	2010/8/20	2010/8/21															
45	Bay A36 (A CH389.29 - A CH400.18)	3 days	2010/8/23	2010/8/25															
46	Bay A35 (A CH374.28 - A CH389.29)	3 days	2010/8/26	2010/8/28															
47	Bay A34 (A CH359.26 - A CH374.28)	3 days	2010/8/30	2010/9/1															
48	Bay A33 (A CH343.21 - A CH359.26) - Transition	3 days	2010/9/2	2010/9/4															
49	Bay A32 (A CH331.09 - A CH343.21) - Transition	3 days	2010/9/6	2010/9/8															
50	Bay A31 (A CH318.91 - A CH331.09) - TG6	3 days	2010/9/9	2010/9/11															

Task Split Progress Milestone Summary

Contract No. : DC/2007/17
 Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen and Tin Sam Tsuen of Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Three Months Rolling Programme - August 2010 to October 2010

ID	Task Name	Duration	Start	Finish	Aug 2010					Sep 2010				Oct 2010						
					25/7	1/8	8/8	15/8	22/8	29/8	5/9	12/9	19/9	26/9	3/10	10/10	17/10	24/10	31/10	
51	Bay A30 (A CH306.75 - A CH318.91) - TG6	3 days	2010/9/13	2010/9/15																
52	Bay A29 (A CH294.59 - A CH306.75) - TG6	3 days	2010/9/16	2010/9/18																
53	Bay A28 (A CH282.43 - A CH294.59) - TG6	3 days	2010/9/20	2010/9/22																
54	Bay A27 (A CH269.95 - A CH282.43) - TG6	3 days	2010/9/24	2010/9/27																
55	Bay A26 (A CH257.09 - A CH269.95) - TG2	3 days	2010/9/28	2010/9/30																
56	Bay A25 (A CH244.23 - A CH257.09) - TG2	3 days	2010/10/2	2010/10/5																
57	Bay A24 (A CH237.50 - A CH244.23) - TG2	3 days	2010/10/6	2010/10/8																
58	Bay A23 (A CH225.47 - A CH237.50) - TG2	3 days	2010/10/9	2010/10/12																
59	Bay A22 (A CH213.44 - A CH225.47) - TG2	3 days	2010/10/13	2010/10/15																
60	Bay A21 (A CH201.41 - A CH213.44) - TG2	3 days	2010/10/18	2010/10/20																
61	Bay A20 (A CH190.69 - A CH201.41) - TG2	3 days	2010/10/21	2010/10/23																
62	Bay A19 (A CH179.97 - A CH190.69) - TG2	3 days	2010/10/25	2010/10/27																
63	Bay A18 (A CH167.00 - A CH179.97) - TG2	3 days	2010/10/28	2010/10/30																
64	Compensatory planting at downstream	25 days	2010/9/1	2010/9/30																
65	Section of Box Culvert BC13-1	75 days	2010/8/2	2010/10/30																
66	Construct box culvert (BC CH0.00 - BC CH386.00)	49 days	2010/8/2	2010/9/28																
67	Excavation for box culvert formation & laying of rock fill material (BC CH0.00 - BC CH384.00)	37 days	2010/8/2	2010/9/13																
68	Bay BC7 (BC CH91.96 - BC CH76.57)	3 days	2010/8/2	2010/8/4																
69	Bay BC11 (BC CH140.65 - BC CH126.63)	3 days	2010/8/2	2010/8/4																
70	Bay BC8 (BC CH106.27 - BC CH91.96)	5 days	2010/8/19	2010/8/24																
71	Bay BC10 (BC CH126.63 - BC CH121.12)	5 days	2010/8/19	2010/8/24																
72	Bay BC9 (BC CH121.12 - BC CH106.27)	5 days	2010/9/8	2010/9/13																
73	Bay BC5 (BC CH61.97 - BC CH46.95)	5 days	2010/9/8	2010/9/13																
74	Construction of box culvert	44 days	2010/8/5	2010/9/25																
75	Bay BC7 (BC CH91.96 - BC CH76.57)	10 days	2010/8/5	2010/8/16																
76	Bay BC11 (BC CH140.65 - BC CH126.63)	10 days	2010/8/5	2010/8/16																
77	Bay BC8 (BC CH106.27 - BC CH91.96)	10 days	2010/8/25	2010/9/4																
78	Bay BC10 (BC CH126.63 - BC CH121.12)	10 days	2010/8/25	2010/9/4																
79	Bay BC9 (BC CH121.12 - BC CH106.27)	10 days	2010/9/14	2010/9/25																
80	Bay BC5 (BC CH61.97 - BC CH46.95)	10 days	2010/9/14	2010/9/25																
81	Backfilling the sides of channel structure & Laying of underground drain pipe	36 days	2010/8/17	2010/9/28																
82	Bay BC7 (BC CH91.96 - BC CH76.57)	2 days	2010/8/17	2010/8/18																
83	Bay BC11 (BC CH140.65 - BC CH126.63)	2 days	2010/8/17	2010/8/18																
84	Bay BC8 (BC CH106.27 - BC CH91.96)	2 days	2010/9/6	2010/9/7																
85	Bay BC10 (BC CH126.63 - BC CH121.12)	2 days	2010/9/6	2010/9/7																
86	Bay BC9 (BC CH121.12 - BC CH106.27)	2 days	2010/9/27	2010/9/28																
87	Bay BC5 (BC CH61.97 - BC CH46.95)	2 days	2010/9/27	2010/9/28																
88	Construction of catchpit / manhole / drain pipe along channel sides	75 days	2010/8/2	2010/10/30																
89	Bay BC29 (BC CH383.63 - BC CH371.47)	3 days	2010/8/2	2010/8/4																
90	Bay BC28 (BC CH371.47 - BC CH362.70)	3 days	2010/8/5	2010/8/7																
91	Bay BC27 (BC CH362.70 - BC CH348.11)	3 days	2010/8/9	2010/8/11																
92	Bay BC26 (BC CH348.11 - BC CH333.53)	3 days	2010/8/12	2010/8/14																
93	Bay BC25 (BC CH333.53 - BC CH318.82)	3 days	2010/8/16	2010/8/18																
94	Bay BC24 (BC CH318.82 - BC CH304.34)	3 days	2010/8/19	2010/8/21																
95	Bay BC23 (BC CH304.34 - BC CH289.87)	3 days	2010/8/23	2010/8/25																
96	Bay BC22 (BC CH289.87 - BC CH275.39)	3 days	2010/8/26	2010/8/28																
97	Bay BC21 (BC CH275.39 - BC CH260.81)	3 days	2010/8/30	2010/9/1																
98	Bay BC20 (BC CH260.81 - BC CH245.97)	3 days	2010/9/2	2010/9/4																
99	Bay BC19 (BC CH245.97 - BC CH231.13)	3 days	2010/9/6	2010/9/8																
100	Bay BC18 (BC CH231.13 - BC CH216.21)	3 days	2010/9/9	2010/9/11																

Task  Split  Progress  Milestone  Summary 

Contract No. : DC/2007/17
 Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen and Tin Sam Tsuen of Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Three Months Rolling Programme - August 2010 to October 2010

ID	Task Name	Duration	Start	Finish	Aug 2010					Sep 2010				Oct 2010					
					25/7	1/8	8/8	15/8	22/8	29/8	5/9	12/9	19/9	26/9	3/10	10/10	17/10	24/10	31/10
101	Bay BC17 (BC CH216.21 - BC CH201.97)	3 days	2010/9/13	2010/9/15															
102	Bay BC16 (BC CH201.97 - BC CH196.48)	3 days	2010/9/16	2010/9/18															
103	Bay BC15 (BC CH196.48 - BC CH184.94)	3 days	2010/9/20	2010/9/22															
104	Bay BC14 (BC CH184.94 - BC CH170.20)	3 days	2010/9/24	2010/9/27															
105	Bay BC13 (BC CH170.20 - BC CH155.56)	3 days	2010/9/28	2010/9/30															
106	Bay BC12 (BC CH155.56 - BC CH140.65)	3 days	2010/10/2	2010/10/5															
107	Bay BC11 (BC CH140.65 - BC CH126.63)	3 days	2010/10/6	2010/10/8															
108	Bay BC10 (BC CH126.63 - BC CH121.12)	3 days	2010/10/9	2010/10/12															
109	Bay BC9 (BC CH121.12 - BC CH106.27)	3 days	2010/10/13	2010/10/15															
110	Bay BC8 (BC CH106.27 - BC CH91.96)	3 days	2010/10/18	2010/10/20															
111	Bay BC7 (BC CH91.96 - BC CH76.57)	3 days	2010/10/21	2010/10/23															
112	Bay B6 (B CH46.00 - B CH57.00) - TG3	3 days	2010/10/25	2010/10/27															
113	Bay B5 (B CH34.00 - B CH46.00) - TG3	3 days	2010/10/28	2010/10/30															
114	Reprovision of playground (BC CH60.00 - BC CH80.00)	33 days	2010/9/20	2010/10/30															
115	Provision of cellular concrete paving at BC CH150.00 - BC CH250.00	24 days	2010/10/2	2010/10/30															
116	Section B	75 days	2010/8/2	2010/10/30															
117	Excavation for channel formation & laying of rock fill material (B CH0.00 - B CH316.00)	10 days	2010/10/2	2010/10/13															
118	Bay B2 (B CH07.00 - B CH14.00) - Transition	5 days	2010/10/2	2010/10/7															
119	Bay B1 (B CH00.00 - B CH07.00) - Transition	5 days	2010/10/8	2010/10/13															
120	Construction of channel structure (Transition, TG3, TG4, TG5, and TG8)	12 days	2010/10/14	2010/10/28															
121	Bay B2 (B CH07.00 - B CH14.00) - Transition	7 days	2010/10/14	2010/10/22															
122	Bay B1 (B CH00.00 - B CH07.00) - Transition	5 days	2010/10/23	2010/10/28															
123	Laying gabion block / granite block inside the channel	56 days	2010/8/2	2010/10/7															
124	Bay B19 (B CH174.00 - B CH188.00) - TG8	4 days	2010/8/2	2010/8/5															
125	Bay B18 (B CH162.00 - B CH174.00) - TG8	4 days	2010/8/6	2010/8/10															
126	Bay B12 (B CH119.00 - B CH129.00) - TG3	4 days	2010/8/11	2010/8/14															
127	Bay B11 (B CH107.00 - B CH119.00) - TG3	4 days	2010/8/16	2010/8/19															
128	Bay B10 (B CH94.00 - B CH107.00) - TG3	4 days	2010/8/20	2010/8/24															
129	Bay B9 (B CH80.00 - B CH94.00) - TG3	4 days	2010/8/25	2010/8/28															
130	Bay B8 (B CH68.00 - B CH80.00) - TG3	4 days	2010/8/30	2010/9/2															
131	Bay B7 (B CH57.00 - B CH68.00) - TG3	4 days	2010/9/3	2010/9/7															
132	Bay B6 (B CH46.00 - B CH57.00) - TG3	4 days	2010/9/8	2010/9/11															
133	Bay B5 (B CH34.00 - B CH46.00) - TG3	4 days	2010/9/13	2010/9/16															
134	Bay B4 (B CH24.00 - B CH34.00) - TG3	4 days	2010/9/17	2010/9/21															
135	Bay B3 (B CH14.00 - B CH24.00) - TG3	4 days	2010/9/22	2010/9/27															
136	Bay B4 (B CH24.00 - B CH34.00) - TG3	4 days	2010/9/28	2010/10/2															
137	Bay B3 (B CH14.00 - B CH24.00) - TG3	4 days	2010/10/4	2010/10/7															
138	Construction of catchpit / manhole / drain pipe along channel sides	75 days	2010/8/2	2010/10/30															
139	Bay B30 (B CH302.00 - B CH312.00) - Transition	3 days	2010/8/2	2010/8/4															
140	Bay B29 (B CH294.00 - B CH302.00) - Transition	3 days	2010/8/5	2010/8/7															
141	Bay B28 (B CH282.00 - B CH294.00) - TG4	3 days	2010/8/9	2010/8/11															
142	Bay B27 (B CH270.00 - B CH282.00) - TG4	3 days	2010/8/12	2010/8/14															
143	Bay B26 (B CH260.00 - B CH270.00) - TG4	3 days	2010/8/16	2010/8/18															
144	Bay B25 (B CH248.00 - B CH260.00) - TG5	3 days	2010/8/19	2010/8/21															
145	Bay B24 (B CH236.00 - B CH248.00) - TG5	3 days	2010/8/23	2010/8/25															
146	Bay B23 (B CH224.00 - B CH236.00) - TG5	3 days	2010/8/26	2010/8/28															
147	Bay B22 (B CH212.00 - B CH224.00) - TG5	3 days	2010/8/30	2010/9/1															
148	Bay B21 (B CH200.00 - B CH212.00) - TG8	3 days	2010/9/2	2010/9/4															
149	Bay B20 (B CH188.00 - B CH200.00) - TG8	3 days	2010/9/6	2010/9/8															
150	Bay B19 (B CH174.00 - B CH188.00) - TG8	3 days	2010/9/9	2010/9/11															

Task  Split  Progress  Milestone  Summary 


Contract No. : DC/2007/17
 Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen and Tin Sam Tsuen of Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Three Months Rolling Programme - August 2010 to October 2010

ID	Task Name	Duration	Start	Finish	Aug 2010					Sep 2010				Oct 2010						
					25/7	1/8	8/8	15/8	22/8	29/8	5/9	12/9	19/9	26/9	3/10	10/10	17/10	24/10	31/10	
151	Bay B18 (B CH162.00 - B CH174.00) - TG8	3 days	2010/9/13	2010/9/15																
152	Bay B17 (B CH154.00 - B CH162.00) - Transition	3 days	2010/9/16	2010/9/18																
153	Bay B16 (B CH147.00 - B CH154.00) - Transition	3 days	2010/9/20	2010/9/22																
154	Bay B15 (B CH144.00 - B CH147.00) - Transition & Pedestrian Crossing	3 days	2010/9/24	2010/9/27																
155	Bay B14 (B CH137.00 - B CH144.00) - Transition	3 days	2010/9/28	2010/9/30																
156	Bay B13 (B CH129.00 - B CH137.00) - Transition	3 days	2010/10/2	2010/10/5																
157	Bay B12 (B CH119.00 - B CH129.00) - TG3	3 days	2010/10/6	2010/10/8																
158	Bay B11 (B CH107.00 - B CH119.00) - TG3	3 days	2010/10/9	2010/10/12																
159	Bay B10 (B CH94.00 - B CH107.00) - TG3	3 days	2010/10/13	2010/10/15																
160	Bay B9 (B CH80.00 - B CH94.00) - TG3	3 days	2010/10/18	2010/10/20																
161	Bay B8 (B CH68.00 - B CH80.00) - TG3	3 days	2010/10/21	2010/10/23																
162	Bay B7 (B CH57.00 - B CH68.00) - TG3	3 days	2010/10/25	2010/10/27																
163	Bay B6 (B CH46.00 - B CH57.00) - TG3	3 days	2010/10/28	2010/10/30																
164	Compensatory planting at upstream	25 days	2010/9/1	2010/9/30																
165																				
166	Section V	75 days	2010/8/2	2010/10/30																
167	Preservation and protection of tree for Section I, II, III and IV	75 days	2010/8/2	2010/10/30																
168																				
169	Section VI - Portion 9A & 9B (Tuen Mun Sewerage Work)	75 days	2010/8/2	2010/10/30																
170	Structural Survey and Monitoring	75 days	2010/8/2	2010/10/30																
171	Construction of Manhole, Timber Box and Trench Excavation	75 days	2010/8/2	2010/10/30																
172																				
173	Section VII - Portion 10A, 10B & 10C (Tuen Mun Sewerage Work)	60 days	2010/8/2	2010/10/12																
174	Structural Survey and Monitoring	60 days	2010/8/2	2010/10/12																
175	Construction of Manhole, Timber Box and Trench Excavation	60 days	2010/8/2	2010/10/12																

Task  Split  Progress  Milestone  Summary 

Appendix C
Environmental Management Organization and
Contacts of Key Personnel

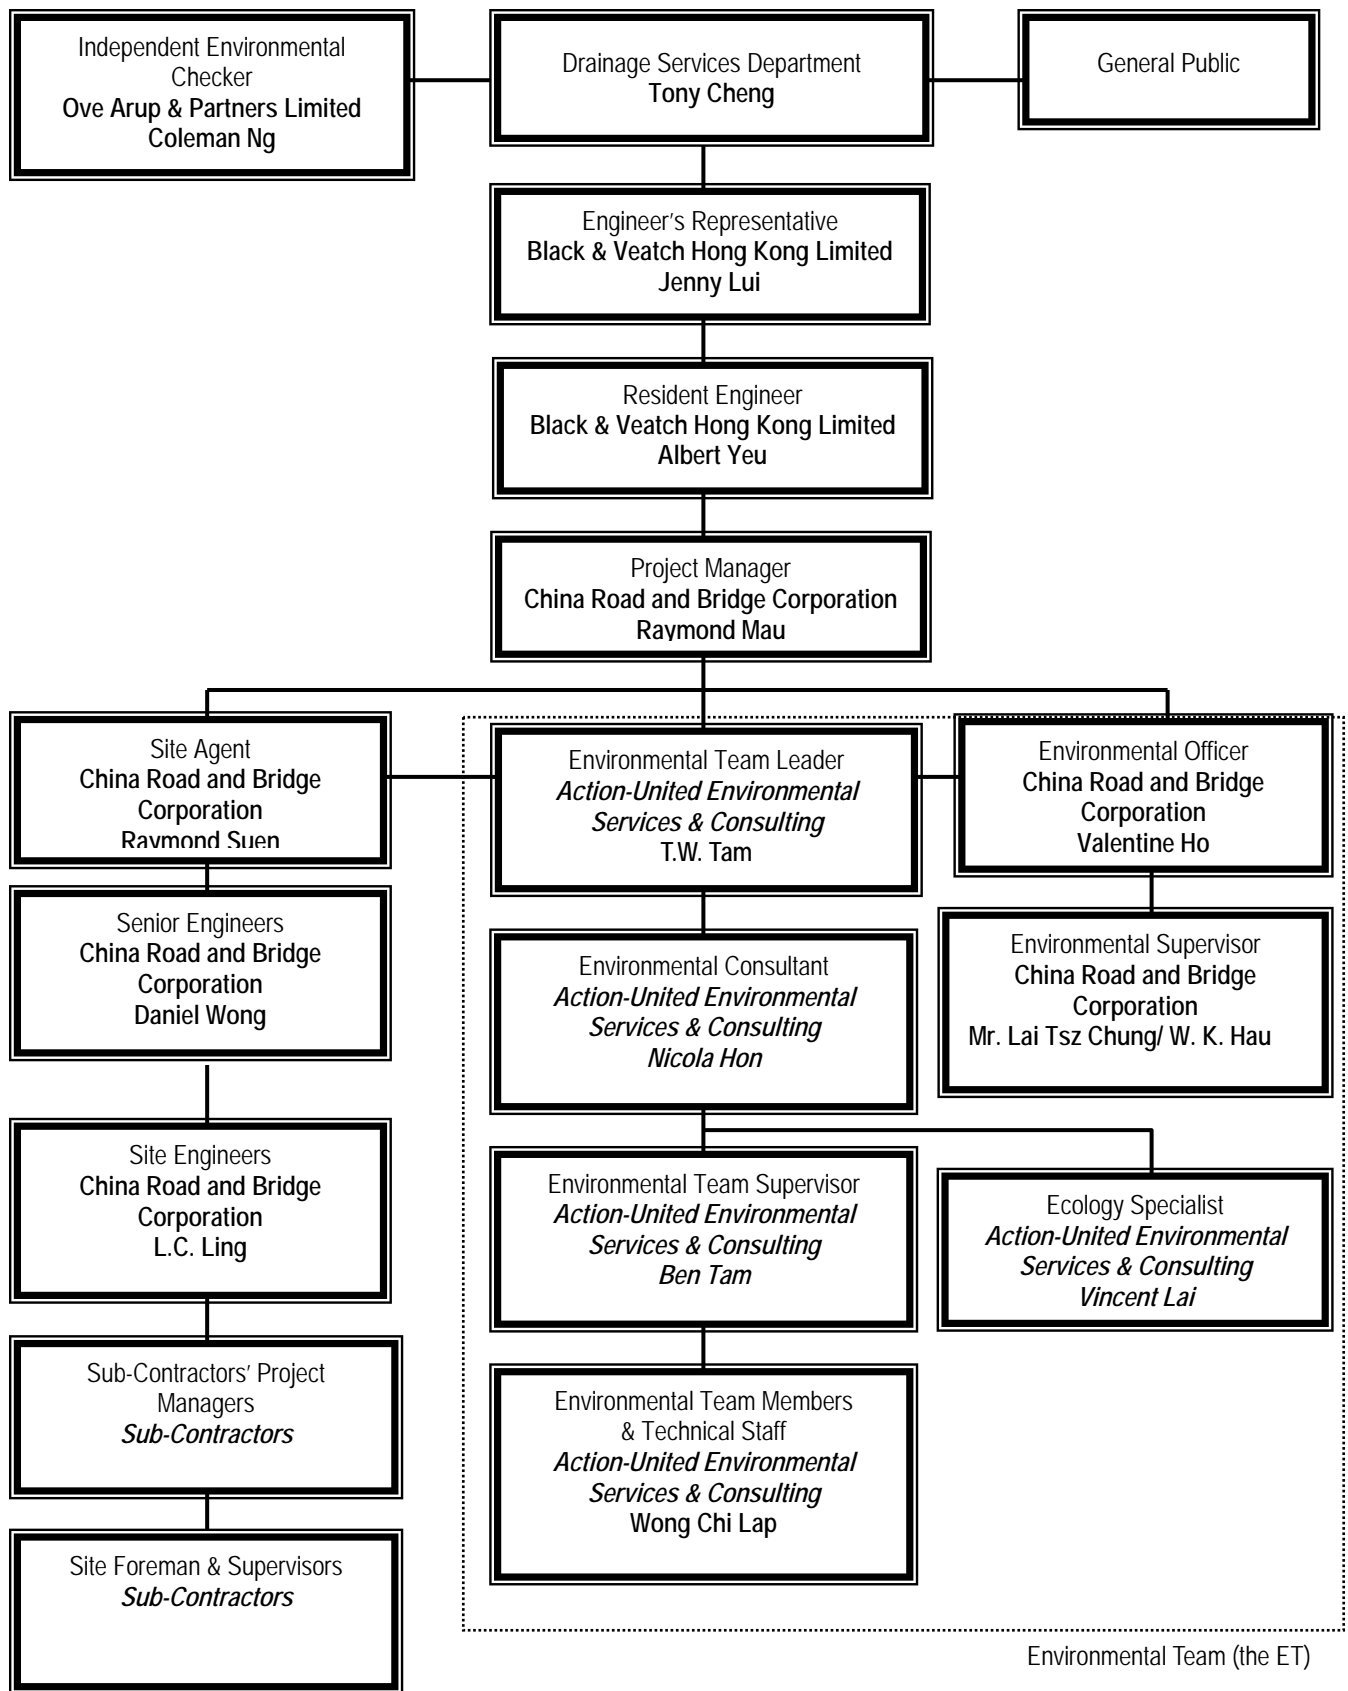

Environmental Management Organization

Contact Details of Key Personnel

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
DSD	Employer	Mr. Tony Cheng	2594-7264	2827-8526
B&V	Engineer's Representative	Ms. Jenny Lui	2478-9161	2478-9369
B&V	Resident Engineer	Mr. Albert Yeu	2478-9161	2478-9369
OAP	Independent Environmental Checker	Mr. Coleman Ng	2268-3097	2268-3950
CRBC	Project Director	Mr. Wang Yanhua	2283-1688	2283-1689
CRBC	Project Manager	Mr. Raymond Mau	9048-3669	2283-1689
CRBC	Site Agent	Mr. Raymond Suen	9779-8871	2283-1689
CRBC	Senior Engineer (Tuen Mun Site)	Mr. Daniel Wong	9858-3176	2283-1689
CRBC	Site Engineer (Tuen Mun Site)	Mr. L.C. Ling	6770-4010	2283-1689
CRBC	Environmental Officer	Mr. Valentine Ho	6474-6975	2283-1689
CRBC	Environmental / Construction Supervisor (Tuen Mun and Yuen Long site)	Mr. Lai Tsz Chung	6283-9696	2283-1689
CRBC	Environmental / Construction Supervisor (Yuen Long site)	Mr. W. K. Hau	9401-6296	2283-1689
CRBC	Safety Officer	Mr. Alexis Wong	9374-8954	2283-1689
AUES	Environmental Team Leader	Mr. T.W. Tam	2959-6059	2959-6079
AUES	Environmental Consultant	Miss Nicola Hon	2959-6059	2959-6079
AUES	Environmental Site Inspector	Mr. Ben Tam	2959-6059	2959-6079
AUES	Ecologist	Mr. Vincent Lai	2959-6059	2959-6079

Legend:

DSD(Employer) – Drainage Services Department

B&V(Engineer) – Black & Veatch Hong Kong Limited

CRBC (Main Contractor) – China Road and Bridge Corporation

OAP(IEC) – Ove Arup & Partners Ltd

AUES (ET) – Action-United Environmental Services & Consulting

Appendix D

(a) Monitoring Schedules

(b) Meteorological Data

Monitoring Schedule for KT 13 for Reporting Period – July 2010

Date		Air Quality		Noise Leq 30min	Water Quality	Ecology Surveys
		1-hour TSP	24-hour TSP			
Sat	26-June-10	A1(a), A2		N1(a), N2(a) & N3	W1,W2, W3(a), W4, W5 & W6	
Sun	27-June-10					
Mon	28-June-10				W1,W2, W3(a), W4, W5 & W6	
Tue	29-June-10					
Wed	30-June-10				W1,W2, W3(a), W4, W5 & W6	
Thu	1-July-10					
Fri	2-July-10		A1(a), A2			
Sat	3-July-10	A1(a), A2		N1(a), N2(a) & N3	W1,W2, W3(a), W4, W5 & W6	
Sun	4-July-10					
Mon	5-July-10				W1,W2, W3(a), W4, W5 & W6	
Tue	6-July-10					
Wed	7-July-10				W1,W2, W3(a), W4, W5 & W6	
Thu	8-July-10		A1(a), A2			
Fri	9-July-10	A1(a), A2		N1(a), N2(a) & N3	W1,W2, W3(a), W4, W5 & W6	
Sat	10-July-10					
Sun	11-July-10					
Mon	12-July-10				W1,W2, W3(a), W4, W5 & W6	
Tue	13-July-10					
Wed	14-July-10		A1(a), A2			
Thu	15-July-10	A1(a), A2		N1(a), N2(a) & N3	W1,W2, W3(a), W4, W5 & W6	
Fri	16-July-10					
Sat	17-July-10				W1,W2, W3(a), W4, W5 & W6	
Sun	18-July-10					
Mon	19-July-10				W1,W2, W3(a), W4, W5 & W6	
Tue	20-July-10		A1(a), A2			
Wed	21-July-10	A1(a), A2		N1(a), N2(a) & N3	W1,W2, W3(a), W4, W5 & W6	
Thu	22-July-10					
Fri	23-July-10					
Sat	24-July-10				W1,W2, W3(a), W4, W5 & W6	
Sun	25-July-10					

Cultural Heritage

Frequency: Condition survey - Bi-monthly
Settlement monitoring - Bi-weekly

Landscape & Visual

Frequency: Bi-weekly

	Monitoring Day
	Sunday or Public Holiday

Monitoring Schedule of KT 13 for next reporting month – August 2010

Date		Air Quality		Noise Leq 30min	Water Quality	Ecology Surveys
		1-hour TSP	24-hour TSP			
Mon	26-July-10		A1(a), A2			
Tue	27-July-10	A1(a), A2		N1(a), N2(a) N3	& W1,W2, W3(a), W4, W5 & W6	
Wed	28-July-10					
Thu	29-July-10				W1,W2, W3(a), W4, W5 & W6	
Fri	30-July-10					
Sat	31-July-10		A1(a), A2		W1,W2, W3(a), W4, W5 & W6	
Sun	1-Aug-10					
Mon	2-Aug-10	A1(a), A2		N1(a), N2(a) N3	& W1,W2, W3(a), W4, W5 & W6	
Tue	3-Aug-10					
Wed	4-Aug-10					
Thu	5-Aug-10				W1,W2, W3(a), W4, W5 & W6	
Fri	6-Aug-10		A1(a), A2			
Sat	7-Aug-10	A1(a), A2		N1(a), N2(a) N3	& W1,W2, W3(a), W4, W5 & W6	
Sun	8-Aug-10					
Mon	9-Aug-10				W1,W2, W3(a), W4, W5 & W6	
Tue	10-Aug-10					
Wed	11-Aug-10				W1,W2, W3(a), W4, W5 & W6	
Thu	12-Aug-10		A1(a), A2			
Fri	13-Aug-10	A1(a), A2		N1(a), N2(a) N3	& W1,W2, W3(a), W4, W5 & W6	
Sat	14-Aug-10					
Sun	15-Aug-10					
Mon	16-Aug-10				W1,W2, W3(a), W4, W5 & W6	
Tue	17-Aug-10					
Wed	18-Aug-10		A1(a), A2			
Thu	19-Aug-10	A1(a), A2		N1(a), N2(a) N3	& W1,W2, W3(a), W4, W5 & W6	
Fri	20-Aug-10					
Sat	21-Aug-10				W1,W2, W3(a), W4, W5 & W6	
Sun	22-Aug-10					
Mon	23-Aug-10				W1,W2, W3(a), W4, W5 & W6	
Tue	24-Aug-10		A1(a), A2			
Wed	25-Aug-10	A1(a), A2		N1(a), N2(a) N3	& W1,W2, W3(a), W4, W5 & W6	

Cultural Heritage

Frequency: Condition survey - Bi-monthly
Settlement monitoring - Bi-weekly

Landscape & Visual

Frequency: Bi-weekly

	Monitoring Day
	Sunday or Public Holiday

Meteorological Data Extracted from HKO during the Reporting Period

Date		Weather	Lau Fau Shan Weather Station				
			Total Rainfall (mm)	Mean Air Temp. (°C)	Wind Speed (km/h)	Mean Relative Humidity (%)	Wind Direction
26-Jun-10	Sat	Mainly cloudy with showers	127.6	25.7	13.5	92.5	SW
27-Jun-10	Sun	There will also be a few squally thunderstorms	44.2	25.2	14.2	93	SE
28-Jun-10	Mon	Showers will be heavy at times at first	43.2	26.1	21.5	92.5	E/SE
29-Jun-10	Tue	Mainly fine. Moderate south to southeasterly winds.	0.1	28.2	8.5	80.2	S/SE
30-Jun-10	Wed	Fine and hot apart from one or two isolated showers.	0	29.2	12	78.7	S/SE
1-Jul-10	Thu	Fine and hot. Moderate west to southwesterly winds.	0	29.3	13	76.5	W
2-Jul-10	Fri	Fine and very hot.	0	30.2	13.5	77.5	W
3-Jul-10	Sat	Moderate southwesterly winds	0	30.7	14.2	75	W/SW
4-Jul-10	Sun	occasionally fresh over offshore waters.	Trace	31.1	20.7	76.5	SW
5-Jul-10	Mon	Mainly fine and hot.	0	31.4	18.7	73.7	SW
6-Jul-10	Tue	Moderate southwesterly winds,	Trace	30.8	20.7	76	SW
7-Jul-10	Wed	occasionally fresh over offshore waters.	Trace	30.6	16	72.5	SW
8-Jul-10	Thu	Fine and very hot. Moderate southwesterly winds.	0.4	31.3	18	72.5	SW
9-Jul-10	Fri	It will be hot.	1.7	30.5	18.7	77	S/SW
10-Jul-10	Sat	Mainly fine apart from isolated showers at first.	3.9	30.6	15.2	70.7	S
11-Jul-10	Sun	Light to moderate southerly winds.	1.8	31.3	20	67	W/SW
12-Jul-10	Mon	Fine and very hot.	Trace	29.8	15	73.5	S/SE
13-Jul-10	Tue	Moderate easterly winds.	Trace	29.6	13.5	74.7	S/SE
14-Jul-10	Wed	Mainly fine and very hot apart from isolated showers.	0	29.4	11.2	79.5	E
15-Jul-10	Thu	Isolated showers and one or two thunderstorms.	8.4	29.4	11.5	78	E
16-Jul-10	Fri	Sunny periods and showers. There are swells over the sea.	17.8	28.4	24.5	77.2	SE
17-Jul-10	Sat	Fine and very hot apart from a few showers.	40	27.5	13.7	80.5	S/SE
18-Jul-10	Sun	Moderate east to southeasterly winds.	1.1	27.7	14.2	76.7	S/SE
19-Jul-10	Mon	Fine and very hot apart from a few showers.	0	29	13.5	78	S/SE
20-Jul-10	Tue	Moderate easterly winds.	0	29.5	12.7	78.5	SE
21-Jul-10	Wed	Fresh easterly winds, occasionally strong over offshore waters. Gale on high ground.	29.6	28.2	15.5	8.5	E
22-Jul-10	Thu	Cloudy with showers and a few squally thunderstorms.	182.4	27.1	18.5	86.7	SE
23-Jul-10	Fri	Cloudy with showers and a few squally thunderstorms.	14.6	28.2	14.5	83.2	S/SE
24-Jul-10	Sat	Mainly cloudy with a few showers and isolated squally thunderstorms.	1.1	28.6	14	83	E
25-Jul-10	Sun	Moderate east to southeasterly winds.	0	28.6	12	78	S/SE

Appendix E

Calibration Certificates and

HOKLAS-Accreditation Certificate

Equipment Calibration List for Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen and Tin Sam Tsuen of Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Item	Issue	Description of Equipment	Date of Calibration	Date of Next Calibration
1 ⁽²⁾	Air	Tisch Calibration Kit Model TE-5025A (Serial No. 1612)	2 Jun 09	2 Jun 10
2 ⁽³⁾		TSP Sampler Calibration Spreadsheet for KT13-A1a	2 Jun 10	2 Aug 10
3 ⁽³⁾		TSP Sampler Calibration Spreadsheet for KT13-A2	2 Jun 10	2 Aug 10
4 ⁽³⁾		TSI DustTrak Model 8520 (Serial No. 21060)	12 Dec 09	12 Dec 10
5 ⁽³⁾		TSI DustTrak Model 8520 (Serial No. 23080)	12 Dec 09	12 Dec 10
6 ⁽³⁾		TSI DustTrak Model 8520 (Serial No. 23079)	5 May 10	5 May 11
7 ⁽⁴⁾	Noise	Bruel & Kjaer Integrating Sound Level Meter 2238 (Serial No. 2285721)	19 Apr 10	19 Apr 11
8 ⁽⁴⁾		Bruel & Kjaer Acoustical Calibrator 4231 (Serial No. 2326408)	27 Apr 10	27 Apr 11
9 ^(*)	Water	YSI 550A (Serial No. 97F0837AM)	19 Apr 10 19 July 10	19 July 10 19 Oct 10
10 ^(*)		Extech pH Meter EC500 (ALS Lab ID: HK1016226)	19 Apr 10 19 July 10	19 July 10 19 Oct 10
11 ^(*)		Turbidimeter HACH 2100p (Serial No. 08070C031408)	30 Apr 10	30 July 10
12 ^(*)		Hand Refractometer ATAGO EQ114 (Serial No. 289468)	19 Apr 10 19 July 10	19 July 10 19 Oct 10

Note: * Calibration certificates will only provide when monitoring equipment is re-calibrate or new.

- ⁽²⁾ The calibration certificates could be referred to the previous EM&A monthly report - June 2009
- ⁽³⁾ The calibration certificates could be referred to the previous EM&A monthly report – July 2010
- ⁽⁴⁾ The calibration certificates could be referred to the previous EM&A monthly report – May 2010

CERTIFICATE OF ANALYSIS



Batch: HK1016226
Date of Issue: 21/07/2010
Client: ACTION UNITED ENVIRO SERVICES
Client Reference:

Calibration of Multimeter

Item : EXTECH pH METER Model No.: EC500
ALS Lab ID: HK1016226 -001 Equipment No.: --
Date of Calibration: 19 July,2010. Serial No.: --

Testing Results :

pH

Expected Reading	Recording Reading
4.00	3.87
7.00	7.01
10.00	10.02
Allowing Deviation	± 0.2 unit

Testing Method:

APHA (20th edition), 4500-H⁺B

CERTIFICATE OF ANALYSIS



Batch: HK1016228
Date of Issue: 22/07/2010
Client: ACTION UNITED ENVIRO SERVICES
Client Reference:

Calibration of Multimeter

Item : HAND REFRACTOMETER Model No.: ATAGO
ALS Lab ID: HK1016228 -001 Equipment No.: EQ114
Date of Calibration: 19 July,2010 Serial No.: 289468

Testing Results :

Salinity

Expected Reading	Recording Reading
10 g/L	10.1 g/L
20 g/L	19.9 g/L
30 g/L	29.0 g/L
Allowing Deviation	± 10%

Testing Method:

APHA (20th edition), 2520 A and B

CERTIFICATE OF ANALYSIS



Batch: HK1016227
Date of Issue: 22/07/2010
Client: ACTION UNITED ENVIRO SERVICES
Client Reference:

Calibration of Multimeter

Item : YSI MULTIMETER Model No.: YSI 55/12FT
ALS Lab ID: HK1016227 -001 Equipment No.: --
Date of Calibration: 19 July,2010. Serial No.: 97F0837AM

Testing Results :

Temperature

Expected Reading	Recording Reading
10.0 °C	10.0 °C
21.0 °C	21.1 °C
39.0 °C	38.9 °C
Allowing Deviation	±2.0°C

Testing Method:

In-House Method HK409

DO

Expected Reading	Recording Reading
7.93 mg/L	7.89 mg/L
6.23 mg/L	6.20 mg/L
5.06 mg/L	5.11 mg/L
Allowing Deviation	± 0.2 mg/L

Testing Method:

APHA (20th edition), 4500-OC & G

CERTIFICATE OF ANALYSIS



Batch: HK1008800
Date of Issue: 30/04/2010
Client: CHIU HING CONSTRUCTION & TRANSPORTATION CO., LTD.
Client Reference:

Calibration of Turbidimeter

Item : Portable Turbidimeter
ALS Lab ID: HK1008800 -001
Date of Calibration: 30 April, 2010
Model No.: HACH 2100P
Equipment No.: 3054010
Serial No.: 08070C031408

Testing Results :

Turbidity

Expected Reading	Recording Reading
0.00 NTU	0.18 NTU
16.0 NTU	14.7 NTU
160 NTU	150 NTU
800 NTU	785 NTU
Allowing Deviation	± 10%

Testing Method:

APHA (19th edition), 2130B


Mr Chan Kwok Fai, Godfrey
Laboratory Manager - Hong Kong

Appendix F

Event and Action Plan

Event/Action Plan for Air Quality

EVENT	ACTION			
	Contractor's ET leader	IEC	ER	Contractor
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source Inform IEC, ER and Contractor Repeat measurement to confirm findings Increase monitoring frequency to daily 	<ol style="list-style-type: none"> Check monitoring data submitted by Contractor's ET leader Check Contractor's working method 	<ol style="list-style-type: none"> Notify Contractor 	<ol style="list-style-type: none"> Rectify any unacceptable practice Amend working methods if appropriate
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Identify source Inform IEC, ER and Contractor Repeat measurement to confirm findings Increase monitoring frequency to daily Discuss with IEC, Contractor and ER on remedial actions required If exceedance continue, arrange meeting with IEC, ER and Contractor If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> Checking monitoring data submitted by Contractor's ET leader. Check Contractor's working method Discuss with Contractor's ET leader and Contractor on possible remedial measures Advise the ER on the effectiveness of the proposed remedial measures Supervise implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify Contractor Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> Submit proposals for remedial actions to IEC and ER within 3 working days of notification Implement the agreed proposals Amend proposal if appropriate
LIMIT LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source Inform IEC, ER, EPD and Contractor Repeat measurement to confirm findings Increase monitoring frequency to daily Assess effectiveness of Contractor's remedial actions and kept IEC, EPD and ER informed of the results 	<ol style="list-style-type: none"> Check monitoring data submitted by Contractor's ET leader Check Contractor's working method Discuss with Contractor's ET leader and Contractor on possible remedial measures Advise the ER on the effectiveness of the proposed remedial measures Audit implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify Contractor Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> Take immediate action to avoid for the exceedance Submit proposals for remedial actions to IEC and ER within 3 working days of notification Implement the agreed proposals Amend proposal if appropriate
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Notify IEC, ER, Contractor and EPD Identify source Repeat measurement to confirm findings Increase monitoring frequency to daily Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented Arrange meeting with IEC, Contractor and ER to discuss the remedial actions to be taken Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> Discuss amongst ER, Contractor's ET leader and Contractor on the potential remedial actions Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly Audit the implementation of remedial measures 	<ol style="list-style-type: none"> Confirm receipt of notification of failure in writing Notify Contractor In consultation with IEC, agree with the Contractor on the remedial measures to be implemented Ensure remedial measures properly implemented If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> Take immediate action to avoid for the exceedance Submit proposals for remedial actions to IEC and ER within 3 working days of notification Implement the agreed proposals Resubmit proposals if problem still not under control Stop the relevant portion of works as determined by the ER until the exceedance is abate.

Event/Action Plan for Construction Noise Monitoring

EVENT	ACTION			
	CONTRACTOR'S ET LEADER	IEC	ER	Contractor
Action Level	<ol style="list-style-type: none"> 1. Notify IEC, Contractor and ER 2. Carry out investigation 3. Report the results of investigation to the IEC, Contractor and ER 4. Discuss with the Contractor and formulate remedial measures 5. Double monitoring frequency 6. Check compliance to Action/Limit Levels after application of mitigation measures 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the Contract's ET leader 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly 3. Review the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of complaint in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analysed noise problem 4. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to ER and IEC 2. Implement noise mitigation proposals
Limit Level	<ol style="list-style-type: none"> 1. Notify IEC, ER, EPD and Contractor 2. Identify Source 3. Repeat measurement to confirm findings 4. Increase monitoring frequency 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented 6. Inform IEC, ER and EPD the causes & actions taken for the exceedances 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results 8. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Discuss amongst ER, Contractor's ET leader and Contractor on the potential remedial actions 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly 3. Audit the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analysed noise problem 4. Ensure remedial measures are properly implemented 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated

Event and Action Plan for Water Quality

Event	ET Leader	IEC	ER	Contractor
Action level being exceeded by one sampling day	Repeat in-situ measurement to confirm findings: Identify Source(s) of impact; Inform IEC an Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; Repeat measurement on next day of exceedance	Discuss with ET and Contractor on the mitigation measures Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly Assess the effectiveness of the implemented mitigation measures.	Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented;	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER; Implement the agreed mitigation measures.
Action level being exceeded by more than one consecutive sampling days	Repeat in-situ measurement to confirm findings: Identify source(s) of impact; Inform IEC and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; Repeat measurement on next day of exceedance.	Discuss with ET and Contractor on the mitigation measures Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly Assess the effectiveness of the implemented mitigation measures.	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contract to critically review the working methods; Made agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures.	Inform the Engineer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures.
Limit level being exceeded by one sampling day	Repeat in-situ measurement to confirm findings: Identify source(s) of impact; Inform IEC, contractor and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level.	Discuss with ET and Contractor on the mitigation measures Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly Assess the effectiveness of the implemented mitigation measures.	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures; Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit level.	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures; As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities.

Event/Action Plan for Ecology

EVENT	ACTION			
	ET Leader	IEC	Engineer	Contractor
ACTION REACHED LEVEL	<ol style="list-style-type: none"> 1. Carry out investigation 2. Review results and assess whether amendment to action level is appropriate 3. Report the results of investigation to the IEC 4. Notify Contractor and Engineer 5. Discuss with the Contractor and formulate remedial measures 6. Repeat survey to confirm results 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by ET 2. Review the proposed remedial measures by the Contractor and advice the Engineer accordingly 3. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analysed problem 4. Ensure remedial measures properly implemented 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further problem 2. Submit proposals for remedial actions to IEC within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control
LIMIT REACHED LEVEL	<ol style="list-style-type: none"> 1. Carry out investigation 2. Review results and assess whether amendment to limit level is appropriate 3. Report the results of investigation to the IEC 4. Notify Contractor and Engineer 5. Discuss with the Contractor and formulate remedial measures 6. Repeat survey to confirm results 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by ET 2. Review the proposed remedial measures by the Contractor and advice the Engineer accordingly 3. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analysed problem 4. Ensure remedial measures properly implemented 5. Issue instruction to stop the relevant portion of the works until the problem is abated (construction period only). 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further problem 2. Submit proposals for remedial actions to IEC within 3 working days of notification 3. Implement the agreed proposals 4. Resubmit proposals if problem still not under control 5. Stop the relevant portion of works as determined by the Engineer until the problem is abated (construction period only)

Event and Action Plan for Cultural Heritage

EVENT	ACTION			
	ET Leader	IEC	ER	Contractor
Action Level	<p>Notify IEC and Contractor to carry out investigation</p> <p>Report reasons of structural damage or instability to the IEC and Contractor Discuss with the Contractor and formulate remedial measures</p> <p>Increase monitoring frequency to once per week to check mitigation effectiveness</p>	<p>Review report of structural damage or instability by the ET.</p> <p>Review proposed remedial measures by the Contractor and advise the ER and Antiquities and Monuments Office (AMO) accordingly</p> <p>Supervise the implementation of remedial measures, with approval from AMO.</p>	<p>Confirm receipt of notification of failure in writing</p> <p>Notify Contractor</p> <p>Require Contractor to propose remedial measures and to notify and seek approval from AMO.</p> <p>Ensure remedial measures are properly implemented.</p>	<p>Notify AMO concerning the damage or structural instability of the cultural heritage resources</p> <p>Submit proposals for repair of damage to cultural heritage resources to AMO for approval and to implement approved measures.</p>
Limit Level	<p>Notify IEC and Contractor to carry out investigation and to stop construction work within 100m of cultural heritage resource to avoid further impact until AMO are satisfied that the relevant structure has been repaired or stabilized to an acceptable level.</p> <p>Report reasons of continued structural damage or instability to the IEC and Contractor Discuss with the Contractor and formulate remedial measures</p> <p>Increase monitoring frequency to daily to check mitigation effectiveness</p>	<p>Review report of structural damage or instability by the ET.</p> <p>Review proposed remedial measures by the Contractor and advise the ER and Antiquities and Monuments Office (AMO) accordingly.</p> <p>Supervise the implementation of remedial measures, with approval from AMO.</p>	<p>Confirm receipt of notification of failure in writing</p> <p>Notify Contractor</p> <p>Require Contractor to propose remedial measures and to notify and seek approval from AMO.</p> <p>Ensure remedial measures are properly implemented.</p>	<p>To carry out investigation and to stop construction work within 100m of cultural heritage resource to avoid further impact until AMO are satisfied that the relevant structure has been repaired or stabilized to an acceptable level.</p> <p>Propose remedial measures for the repair and stabilization of cultural heritage resources, up to liaison of moving and rebuilding the relevant structure with the approval of owner (usually the clan members) and AMO.</p>

Event and Action Plan for Landscape and Visual Impact - Construction Phase

Action Level	Environmental Team Leader (ETL)	Independent Environmental Checker (IEC)	Engineer's Representative (ER)	Contractor
Non-conformity on one occasion	<ol style="list-style-type: none"> 1. Identify source 2. Inform the IEC and the ER 3. Discuss remedial actions with the IEC, the ER and the Contractor 4. Monitor remedial actions until rectification has been completed 	<ol style="list-style-type: none"> 1. Check report 2. Check the Contractor's working method 3. Discuss with the ER and the Contractor on possible remedial measures 4. Advise the ER on effectiveness of proposed remedial measures 	<ol style="list-style-type: none"> 1. Notify the Contractor 2. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Amend working methods 2. Rectify damage and undertake remedial measures or any necessary replacement
Repeated Non-conformity	<ol style="list-style-type: none"> 1. Identify source 2. Inform the IEC and the ER 3. Increase monitoring (site audit) frequency 4. Discuss remedial actions with the IEC, the ER and the Contractor 5. Monitor remedial actions until rectification has been completed 6. If exceedance stops, cease additional monitoring (site audit) 	<ol style="list-style-type: none"> 1. Check report 2. Check the Contractor's working method 3. Discuss with the ER and the Contractor on possible remedial measures 4. Advise the ER on effectiveness of proposed remedial measures 5. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Notify the Contractor 2. Ensure remedial measures are properly implemented 	<ol style="list-style-type: none"> 1. Amend working methods 2. Rectify damage and undertake remedial measures or any necessary replacement

Appendix G

(a) Impact Environmental Monitoring Data

(b) Graphic Plot of Monitoring

- 1. Construction Noise**
- 2. Air Quality**
- 3. Water Quality**

DSD CONTRACT NO. DC/2007/17
 Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen and Tin Sam Tsuen of
 Yuen Long District and Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

24-Hour TSP Monitoring Results

DATE	SAMPLE NUMBER	STANDARD											BLANK			SAMPLE OF FILTER PAPER			Dust 24-Hr TSP in Air ($\mu\text{g}/\text{m}^3$)	Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level ($\mu\text{g}/\text{m}^3$)
		ELAPSED TIME			CHART READING		AVERAGE			FLOW	AIR	SAMPLE NUMBER	WEIGHT (g)		WEIGHT (g)						
		INITIAL	FINAL	(min)	MIN	MAX	CHART READING	TEMP ($^{\circ}\text{C}$)	PRESS (hPa)	RATE (m^3/min)	VOLUME (std m^3)		INITIAL	FINAL	DIFF	INITIAL	FINAL	DUST COLLECTION			
KT13(A1(a))																					
Date of Calibration: 2-Jun-2010 Next Calibration Date: 2-Aug-2010 Cal Graph Slope = 40.1021 Intercept = -17.4262																					
2-Jul-10	22192	2672.27	2696.02	1425.00	36	38	37.0	30.0	1007.7	1.35	1919	NA	2.8645	2.8641	-0.0004	2.7983	2.8288	0.0305	16	144	260
8-Jul-10	22228	2696.02	2719.80	1426.80	36	38	37.0	30.6	1008.1	1.35	1921	NA	2.8640	2.8638	-0.0002	2.8757	2.9528	0.0771	40	144	260
14-Jul-10	22251	2719.80	2743.58	1426.80	36	38	37.0	30.2	1008.4	1.35	1922	NA	2.8638	2.8631	-0.0007	2.8747	2.9297	0.0550	29	144	260
20-Jul-10	22285	2743.58	2767.40	1429.20	36	38	37.0	29.5	1008.6	1.35	1927	NA	2.8631	2.8635	0.0004	2.9005	2.9444	0.0439	23	144	260
KT13(A2)																					
Date of Calibration: 2-Jun-2010 Next Calibration Date: 2-Aug-2010 Cal Graph Slope = 40.3112 Intercept = -15.746																					
2-Jul-10	22196	2704.09	2727.31	1393.20	36	38	37.0	30.0	1007.7	1.30	1809	NA	2.8645	2.8641	-0.0004	2.7962	2.8206	0.0244	14	141	260
8-Jul-10	22216	2727.31	2750.46	1389.00	36	38	37.0	30.6	1008.1	1.30	1802	NA	2.8640	2.8638	-0.0002	2.8574	2.8825	0.0251	14	141	260
14-Jul-10	22250	2750.46	2773.52	1383.60	36	38	37.0	30.2	1008.4	1.30	1796	NA	2.8638	2.8631	-0.0007	2.8826	2.9104	0.0278	16	141	260
20-Jul-10	22284	2773.52	2796.59	1384.20	36	38	37.0	29.5	1008.6	1.30	1799	NA	2.8631	2.8635	0.0004	2.9097	2.9345	0.0248	14	141	260

Summary of Water Quality Monitoring Results - KT13

Date 26-Jun-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS		Ammonia N		Zinc	
W1	09:31	0.10	29.7	29.9	4.51	4.4	56.1	55.5	6.5	5.6	7.9	8.0	<2	2.0	<0.01	0.01	19	19.0
			30.1		4.37		54.9		4.7		8.1		<2		<0.01		19	
W2	09:47	0.10	29.4	29.5	4.68	4.6	59.7	59.4	4.6	5.0	7.7	7.7	<2	2.0	<0.01	0.01	12	12.0
			29.6		4.57		59.1		5.3		7.7		<2		<0.01		12	
W3	10:09	0.20	30.2	30.2	3.19	3.1	43.2	42.4	5.2	5.0	7.6	7.6	<2	2.0	<0.01	0.01	<10	10.0
			30.1		3.04		41.6		4.7		7.6		<2		<0.01		<10	
W4	10:21	0.10	29.8	29.8	2.96	2.9	40.1	38.5	4.2	4.2	7.5	7.5	<2	2.0	<0.01	0.01	10	10.0
			29.8		2.91		36.9		4.1		7.5		<2		<0.01		10	
W5	10:46	0.10	29.4	29.5	2.87	2.8	39.7	38.9	4.8	4.2	7.4	7.5	<2	2.0	<0.01	0.01	10	10.0
			29.5		2.67		38.1		3.6		7.5		<2		<0.01		10	
W6	10:59	0.20	29.7	29.7	2.19	2.1	38.2	37.8	10.4	10.1	7.3	7.4	<2	2.0	<0.01	0.01	<10	10.0
			29.7		2.07		37.4		9.7		7.5		<2		<0.01		<10	

Date 28-Jun-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS		Ammonia N		Zinc	
W1	10:02	0.10	25.7	25.7	3.78	3.7	50.6	50.2	4.7	4.8	7.7	7.8	184	184.0	1.56	1.56	84	84.0
			25.6		3.62		49.7		4.9		7.9		184		1.56		84	
W2	10:13	0.10	25.4	25.6	3.57	3.5	48.1	47.2	4.4	4.1	7.9	7.9	174	174.0	1.57	1.57	78	78.0
			25.7		3.42		46.3		3.8		7.8		174		1.57		78	
W3	10:17	0.20	25.3	25.5	3.19	3.0	44.1	42.4	3.6	3.8	7.7	7.7	179	179.0	1.8	1.80	81	81.0
			25.6		2.87		40.6		3.9		7.7		179		1.8		81	
W4	10:29	0.10	25.4	25.5	3.71	3.7	49.2	48.8	4.7	4.8	7.9	7.8	207	207.0	1.57	1.57	87	87.0
			25.5		3.6		48.3		4.9		7.7		207		1.57		87	
W5	10:33	0.10	25.6	25.6	2.82	2.8	40.6	40.2	5.1	5.7	7.8	7.8	197	197.0	1.53	1.53	84	84.0
			25.6		2.75		39.7		6.2		7.7		197		1.53		84	
W6	10:39	0.20	25.4	25.6	2.08	2.2	32.9	34.2	7.7	7.6	7.8	7.9	182	182.0	1.76	1.76	76	76.0
			25.7		2.33		35.4		7.4		7.9		182		1.76		76	

Date 30-Jun-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS		Ammonia N		Zinc	
W1	17:30	0.10	29.3	29.8	3.78	4.2	50.9	51.4	6.8	6.9	8.59	8.8	53	53.0	0.01	0.01	96	96.0
			30.2		4.59		51.8		6.9		9.02		53		0.01		96	
W2	17:40	0.10	29.1	29.6	5.43	5.4	48.4	48.0	6.5	6.5	8.44	8.4	22	22.0	0.01	0.01	68	68.0
			30.1		5.27		47.6		6.4		8.35		22		0.01		68	
W3	17:50	0.10	29.2	29.6	6.48	6.5	44.4	44.6	6.7	6.7	8.56	8.5	31	31.0	<0.01	0.01	64	64.0
			29.9		6.52		44.9		6.8		8.44		31		<0.01		64	
W4	18:00	0.10	29.1	29.6	6.54	6.5	43.7	43.3	6.5	6.5	8.52	8.6	54	54.0	0.02	0.02	100	100.0
			30.1		6.49		42.8		6.4		8.63		54		0.02		100	
W5	18:10	0.15	29.4	29.8	2.69	2.6	51.2	50.1	6.6	6.1	8.91	8.8	56	56.0	0.02	0.02	138	138.0
			30.1		2.53		49.0		5.6		8.78		56		0.02		138	
W6	18:20	0.20	29.2	29.7	3.27	3.4	47.2	47.9	6.7	6.8	8.44	8.5	27	27.0	<0.01	0.01	54	54.0
			30.1		3.45		48.6		6.8		8.56		27		<0.01		54	

Date 3-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS		Ammonia N		Zinc	
W1	09:09	0.10	28.7	28.8	2.42	2.7	43.1	46.0	4.7	4.6	7.8	7.7	<2	2.0	0.8	0.80	<10	10.0
			28.9		2.91		48.9		4.4		7.6		<2		0.8		<10	
W2	09:27	0.10	28.6	28.7	3.73	3.6	49.6	49.0	4.3	4.2	7.7	7.7	<2	2.0	0.74	0.74	<10	10.0
			28.7		3.41		48.3		4.1		7.7		<2		0.74		<10	
W3	09:41	0.10	28.7	28.7	3.51	3.5	50.2	50.4	4.6	4.4	8	8.1	<2	2.0	0.83	0.83	<10	10.0
			28.4		2.91		44.2		4.3		7.3		<2		0.97		<10	
W4	09:58	0.20	28.2	28.4	2.6	2.8	45.3	44.8	4.1	4.2	7.3	7.3	<2	2.0	0.97	0.97	<10	10.0
			28.3		2.17		52.1		5.9		7.4		<2		0.71		<10	
W5	10:09	0.10	28.2	28.3	2.14	2.2	50.4	51.3	5.7	5.8	7.6	7.5	<2	2.0	0.71	0.71	<10	10.0
			28.3		2.21		45.6		10.4		8.2		<2		0.03		<10	
W6	10:18	0.10	28.3	28.3	2.12	2.2	42.8	44.2	10.2	10.3	8.2	8.2	2	2.0	0.03	0.03	<10	10.0
			28.3		2.12		42.8		10.2		8.2		2		0.03		<10	

Date 5-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS		Ammonia N		Zinc	
W1	13:07	0.10	30.2	30.3	3.14	3.4	43.6	45.9	6.4	6.7	7.7	7.7	33	33.0	11.9	11.90	19	19.0
			30.3		3.61		48.1		7.0		7.7		33		11.9		19	
W2	13:22	0.10	30.1	30.1	3.22	3.4	44.7	46.8	6.3	6.4	7.8	7.9	39	39.0	11.6	11.60	19	19.0
			30.0		3.67		48.9		6.5		7.9		39		11.6		19	
W3	13:25	0.10	30.2	30.1	3.48	3.4	47.1	44.9	6.6	6.7	7.7	7.8	36	36.0	11.3	11.30	36	36.0
			30.0		3.25		42.6		6.8		7.8		36		11.3		36	
W4	13:31	0.15	30.2	30.1	3.61	3.5	48.0	47.2	6.7	6.6	7.8	7.9	34	34.0	11.7	11.70	20	20.0
			29.9		3.42		46.3		6.5		7.9		34		11.7		20	
W5	13:42	0.10	30.1	30.2	3.31	3.3	45.4	45.1	6.9	6.5	7.7	7.7	35	35.0	12.1	12.10	19	19.0
			30.3		3.27		44.8		6.1		7.7		35		12.1		19	
W6	13:57	0.10	30.3	30.2	3.41	3.5	44.2	45.3	8.4	8.6	7.8	7.9	37	37.0	11.6	11.60	20	20.0
			30.1		3.61		46.3		8.7		7.9		37		11.6		20	

Date 7-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS		Ammonia N		Zinc	
W1	14:03	0.10	29.8	29.9	3.05	3.4	43.2	47.5	5.6	5.6	7.7	7.7	88	88.0	2.06	2.06	58	58.0
			29.9		3.81		51.7		5.5		7.7		88		2.06		58	
W2	14:27	0.10	30.0	30.1	3.06	3.1	43.2	43.9	5.8	5.9	7.8	7.9	61	61.0	1.97	1.97	35	35.0
			30.1		3.17		44.6		5.9		7.9		61		1.97		35	
W3	14:30	0.10	30.1	30.0	2.81	2.7	41.1	39.5	6.1	6.0	7.9	7.9	70	70.0	1.96	1.96	38	38.0
			29.9		2.51		37.9		5.9		7.8		70		1.96		38	
W4	14:43	0.15	29.8	29.9	2.61	2.5	39.2	37.7	6.3	6.3	7.7	7.7	80	80.0	1.98	1.98	102	102.0
			29.9		2.34		36.2		6.3		7.6		80		1.98		102	
W5	14:51	0.10	29.8	29.8	2.07	2.1	33.8	34.0	5.8	5.8	7.6	7.8	83	83.0	1.96	1.96	55	55.0
			29.8		2.11		34.1		5.7		7.9		83		1.96		55	
W6	14:53	0.15	29.9	29.9	2.81	2.6	40.6	39.1	9.1	9.3	7.6	7.8	84	84.0	2.04	2.04	56	56.0
			29.8		2.42		37.6		9.4		7.9		84		2.04		56	

Summary of Water Quality Monitoring Results - KT13

Date 12-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS	Ammonia N		Zinc		
W1	14:27	0.10	29.9	30.0	3.14	2.9	46.5	44.4	7.1	7.2	7.8	7.8	12	12.0	7.62	7.62	13	13.0
			30.0		2.69		42.2		7.3		7.2		7.62		13			
W2	14:39	0.10	29.8	29.8	2.81	2.6	43.2	41.5	7.6	7.7	7.7	7.8	14	14.0	7.46	7.46	13	13.0
			29.7		2.42		39.7		7.8		7.9		7.46		13			
W3	14:41	0.10	29.9	29.9	2.37	2.5	38.8	40.1	7.2	7.2	7.7	7.8	16	16.0	7.52	7.52	13	13.0
			29.8		2.61		41.3		7.1		7.2		7.52		13			
W4	14:45	0.15	29.7	29.8	2.55	2.7	40.7	42.0	6.8	7.0	7.9	7.9	14	14.0	7.45	7.45	14	14.0
			29.8		2.81		43.3		7.1		7.0		7.45		14			
W5	14:53	0.10	29.7	29.8	2.61	2.6	41.3	40.9	6.4	6.4	7.8	7.9	13	13.0	7.81	7.81	14	14.0
			29.8		2.49		40.4		6.3		6.4		7.81		14			
W6	14:59	0.10	29.9	30.0	3.07	3.1	45.6	46.2	8.8	9.1	7.9	7.8	14	14.0	7.66	7.66	12	12.0
			30.0		3.14		46.7		9.3		9.1		7.66		12			

Date 15-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS	Ammonia N		Zinc		
W1	09:14	0.10	28.6	28.7	2.46	2.7	44.2	45.9	4.9	4.6	7.7	7.8	<2	2.0	4	4.00	10	10.0
			28.7		2.92		47.6		4.3		4.6		7.8		<2		4	
W2	09:31	0.10	28.4	28.4	3.79	3.5	48.6	48.0	4.4	4.3	7.4	7.4	<2	2.0	3.83	3.83	<10	10.0
			28.4		3.29		47.3		4.1		4.3		7.4		<2		3.83	
W3	09:49	0.10	28.8	28.8	3.56	3.5	50.1	50.4	4.6	4.5	7.6	7.6	17	17.0	4.75	4.75	18	18.0
			28.8		3.47		50.6		4.3		4.5		7.6		17		4.75	
W4	10:07	0.20	28.5	28.5	2.96	2.7	44.2	44.8	4.4	4.3	7.6	7.7	<2	2.0	3.99	3.99	<10	10.0
			28.4		2.45		45.3		4.2		4.3		7.7		<2		3.99	
W5	10:19	0.10	28.6	28.6	2.18	2.2	52.7	51.5	5.8	5.7	7.8	7.8	<2	2.0	2.94	2.94	<10	10.0
			28.6		2.17		50.3		5.6		5.7		7.8		<2		2.94	
W6	10:28	0.10	28.6	28.7	2.21	2.2	45.7	44.3	10.7	10.5	7.9	7.9	15	15.0	3.94	3.94	16	16.0
			28.7		2.14		42.9		10.3		10.5		7.9		15		3.94	



Date 17-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS	Ammonia N		Zinc		
W1	11:07	0.10	26.7	26.6	3.87	3.9	50.3	51.0	4.9	4.0	7.9	8.0	36	36.0	4.04	4.04	23	23.0
			26.4		3.94		51.6		4.2		4.0		8		36		4.04	
W2	11:21	0.10	26.5	26.6	3.82	4.0	50.1	52.2	5.6	5.6	7.9	7.9	38	38.0	3.94	3.94	22	22.0
			26.6		4.18		54.2		5.5		5.6		7.9		38		3.94	
W3	11:26	0.10	26.6	26.7	4.27	4.3	54.6	55.5	4.6	4.7	7.9	8.0	37	37.0	3.99	3.99	24	24.0
			26.9		4.39		56.3		4.8		4.7		8.1		37		3.99	
W4	11:31	0.20	26.7	26.6	3.68	3.5	49.1	46.2	3.9	4.3	8	8.0	28	28.0	3.43	3.43	186	186.0
			26.5		3.28		43.3		4.7		4.3		8		28		3.43	
W5	11:38	0.10	28.5	26.5	4.05	4.0	52.6	52.2	4.3	4.4	8.1	8.0	41	41.0	3.96	3.96	26	26.0
			26.4		3.98		51.7		4.5		4.4		7.9		41		3.96	
W6	11:47	0.10	26.4	26.5	2.71	2.7	39.4	39.1	7.2	7.4	7.7	7.8	34	34.0	3.85	3.85	20	20.0
			26.5		2.69		38.7		7.6		7.4		7.8		34		3.85	


Date 19-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS	Ammonia N		Zinc		
W1	17:15	0.10	30.4	30.1	6.54	6.5	153.8	149.0	3.8	4.2	8.57	8.7	12	12.0	3.82	3.82	<10	10.0
			29.8		6.43		144.2		4.6		4.2		8.77		12		3.82	
W2	17:20	0.10	29.7	29.4	6.67	6.5	187.5	182.0	4.8	5.0	8.22	8.4	14	14.0	5.62	5.62	<10	10.0
			29.1		6.23		176.4		5.2		5.0		8.55		14		5.62	
W3	17:30	0.10	29.1	29.1	5.86	5.9	169.1	166.7	4.0	4.2	8.59	8.5	10	10.0	4.35	4.35	<10	10.0
			29.1		5.86		164.2		4.5		4.2		8.41		10		4.35	
W4	17:40	0.10	28.9	28.9	5.55	5.5	177.4	177.0	5.0	5.1	8.51	8.6	14	14.0	4.49	4.49	11	11.0
			28.8		5.43		176.5		5.3		5.1		8.73		14		4.49	
W5	17:50	0.15	28.9	28.8	6.52	6.5	143.2	149.7	3.5	4.3	8.56	8.5	12	12.0	4.67	4.67	<10	10.0
			28.7		6.41		156.1		5.1		4.3		8.42		12		4.67	
W6	18:00	0.20	28.7	28.7	6.38	6.3	179.2	183.8	3.6	3.7	8.43	8.5	15	15.0	4.44	4.44	10	10.0
			28.6		6.25		188.3		3.8		3.7		8.56		15		4.44	

Date 21-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS	Ammonia N		Zinc		
W1	10:17	0.10	29.4	29.1	3.44	3.4	49.1	49.2	5.5	5.6	8.1	8.1	<2	2.0	<0.01	0.01	<10	10.0
			28.8		3.45		49.2		5.6		5.6		8		<2		<0.01	
W2	10:31	0.10	28.7	28.4	4.67	4.7	55.2	55.9	4.8	4.7	7.9	7.9	<2	2.0	<0.01	0.01	<10	10.0
			28.1		4.68		56.5		4.5		4.7		7.8		<2		<0.01	
W3	10:36	0.10	28.4	28.4	4.12	4.2	54.6	54.6	6.5	6.7	8	7.9	<2	2.0	<0.01	0.01	<10	10.0
			28.4		4.2		54.5		6.8		6.7		7.8		<2		<0.01	
W4	10:41	0.10	29.1	29.1	3.28	3.3	48.5	48.5	6.1	6.2	7.7	7.8	<2	2.0	<0.01	0.01	<10	10.0
			29.1		3.25		48.4		6.2		6.2		7.8		<2		<0.01	
W5	10:48	0.15	28.8	28.8	4.02	4.0	52.6	52.2	5.6	5.7	8	8.1	<2	2.0	<0.01	0.01	<10	10.0
			28.8		4.05		51.7		5.7		5.7		8.1		<2		<0.01	
W6	10:57	0.20	28.9	28.9	3.55	3.6	48.1	48.3	7.5	7.6	8.2	8.2	<2	2.0	<0.01	0.01	<10	10.0
			28.9		3.65		48.5		7.6		7.6		8.1		<2		<0.01	



Date 24-Jul-10																		
Location	Time	Depth (m)	Temp (oC)		DO (mg/L)		DOS (%)		Turbidity (NTU)		pH		SS	Ammonia N		Zinc		
W1	11:20	0.10	28.4	28.5	3.61	3.8	46.1	48.2	6.1	6.0	8.1	8.0	13	13.0	1.7	1.70	21	21.0
			28.6		3.98		50.2		5.9		6.0		7.9		13		1.7	
W2	11:34	0.10	28.6	28.7	4.07	3.8	50.5	48.2	4.7	4.8	7.9	7.9	18	18.0	1.6	1.60	31	31.0
			28.8		3.58		45.9		4.9		4.8		7.9		18		1.6	
W3	11:38	0.10	28.7	28.7	3.42	3.5	44.3	45.5	5.9	6.0	7.8	7.9	16	16.0	1.71	1.71	31	31.0
			28.6		3.65		46.7		6.1		6.0		8		16		1.71	
W4	11:41	0.10	28.6	28.6	3.83	3.8	48.3	47.6	6.2	6.3	7.8	7.8	22	22.0	1.4	1.40	28	28.0
			28.5		3.67		46.8		6.3		6.3		7.8		22		1.4	
W5	11:43	0.15	28.7	28.7	3.42	3.7	44.3	47.0	4.7	4.8	7.7	7.8	14	14.0	1.48	1.48	24	24.0
			28.6		3.92		49.6		4.9		4.8		7.9		14		1.48	
W6	11:51	0.20	28.8	28.8	3.04	3.1	40.8	40.9	10.									



Graphic Plot of Monitoring - Construction Noise

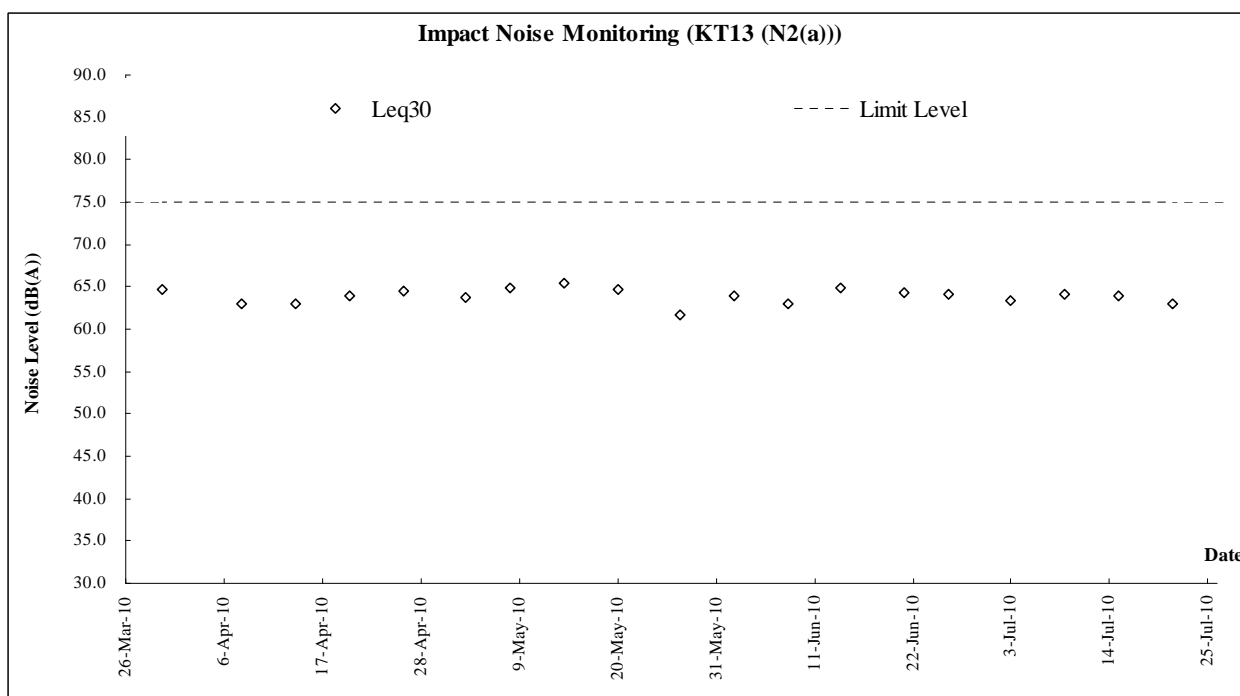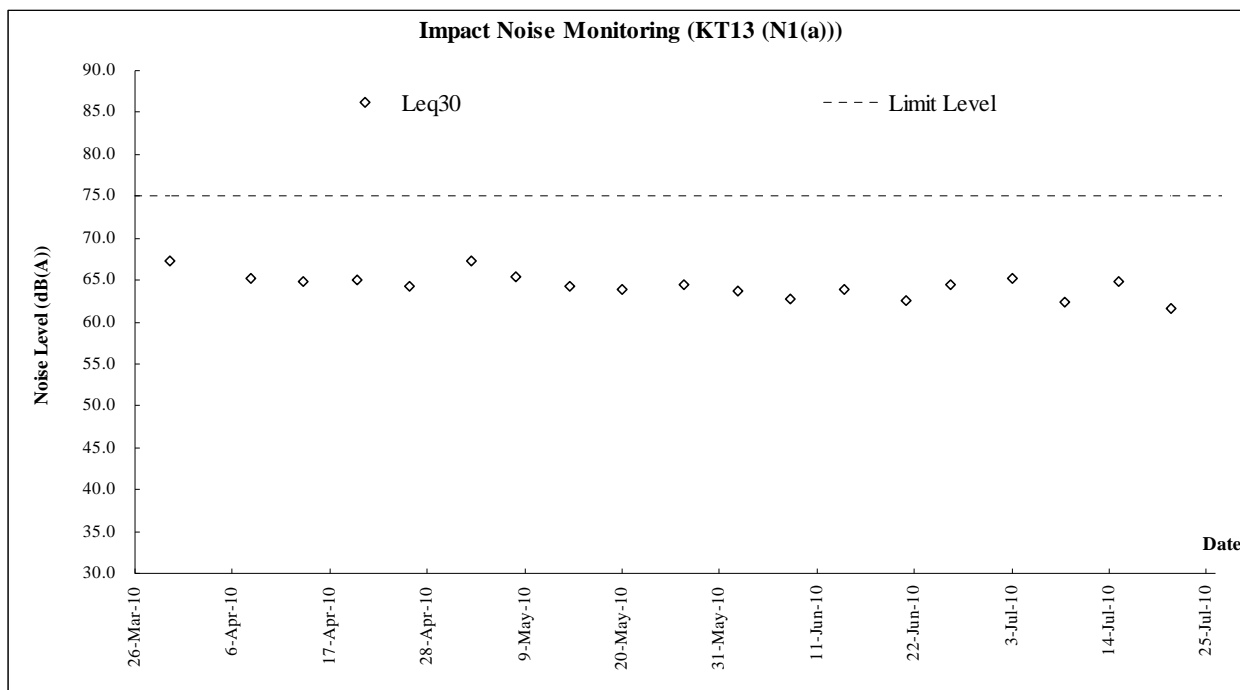


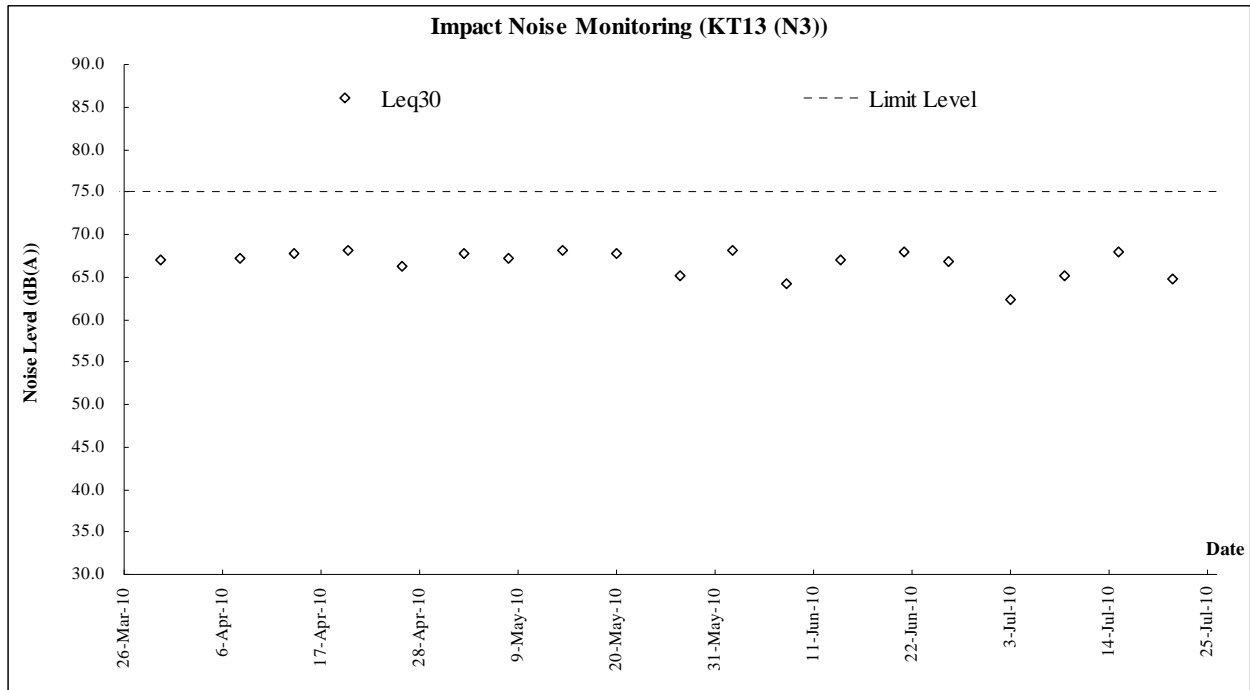




Graphic Plot of Monitoring – Air Quality

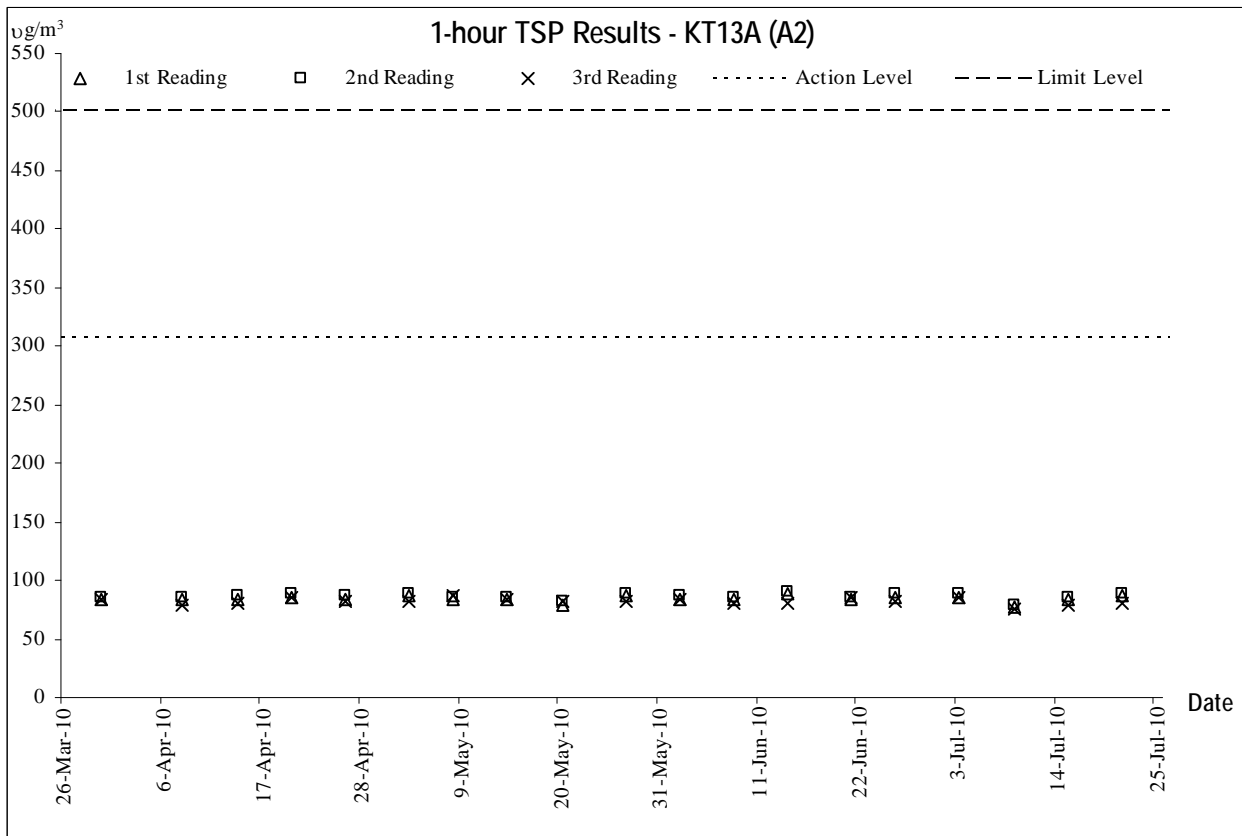
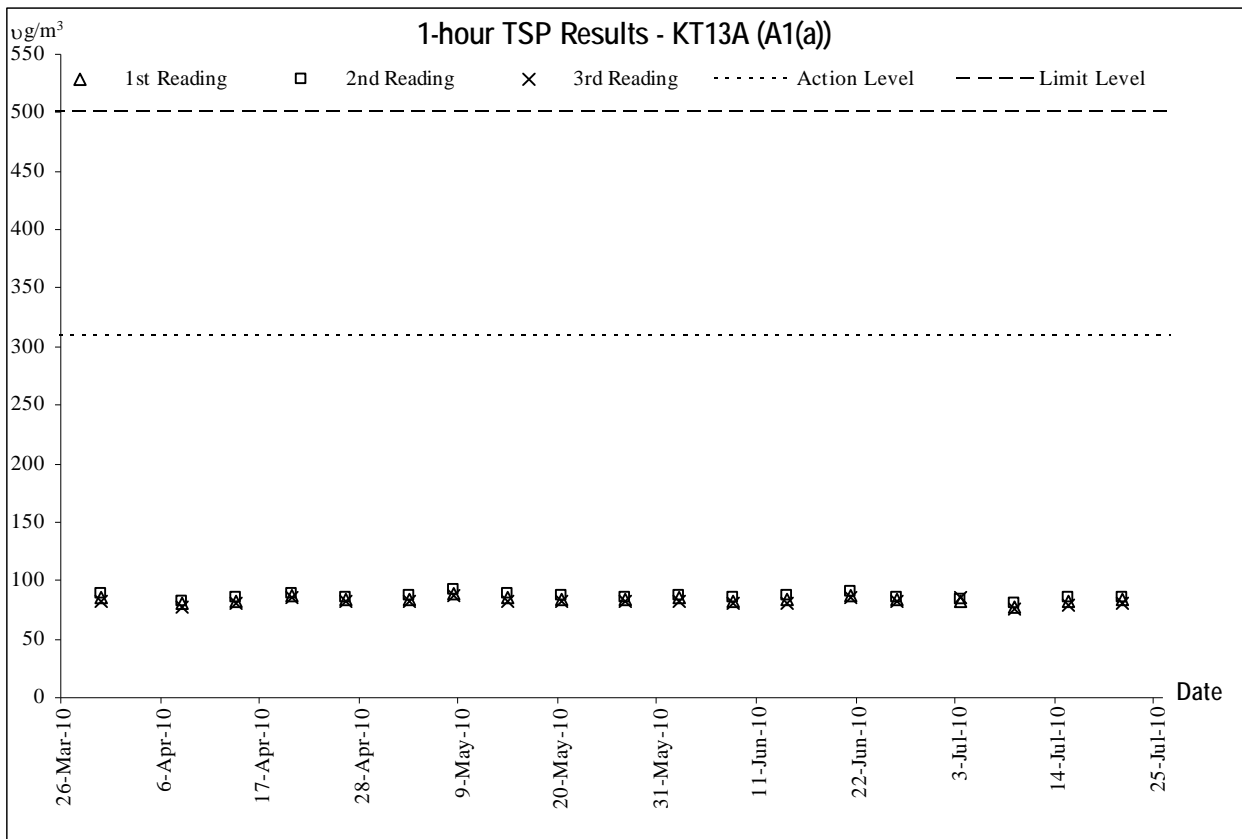


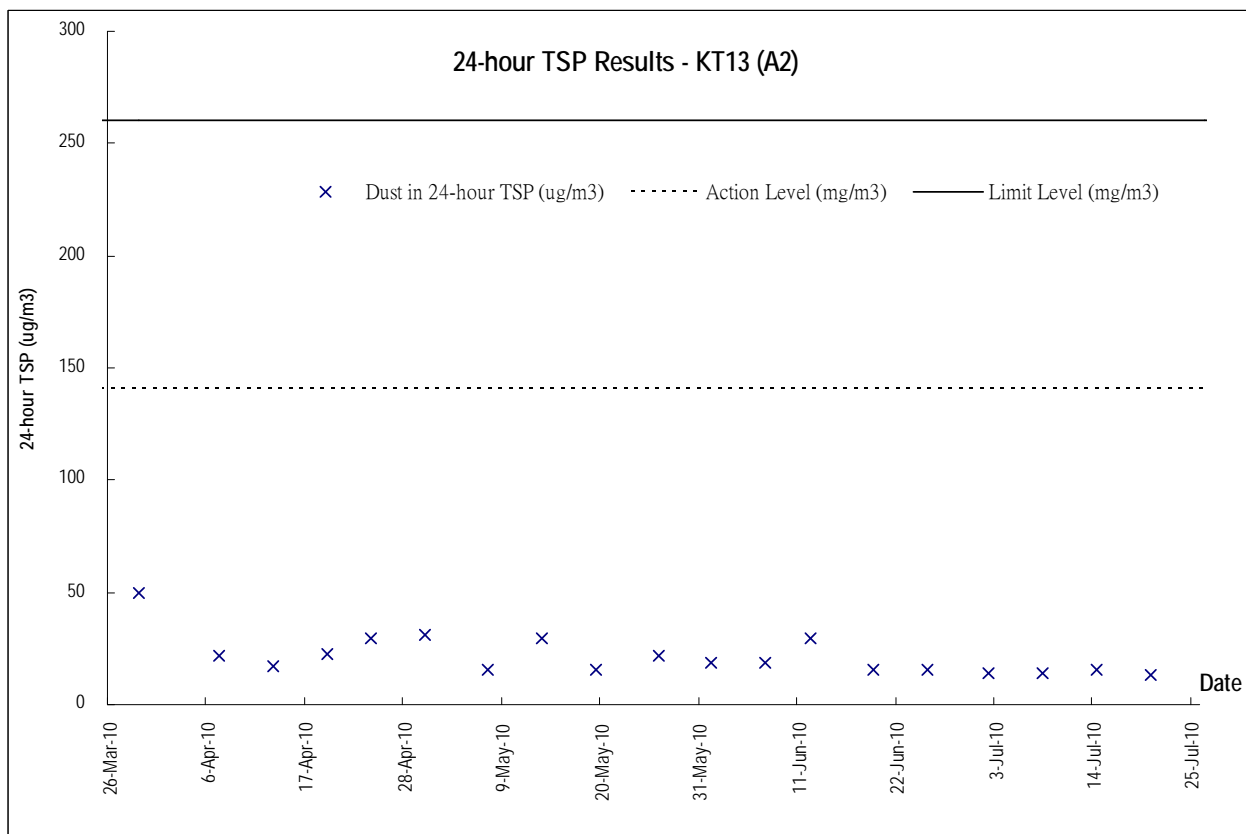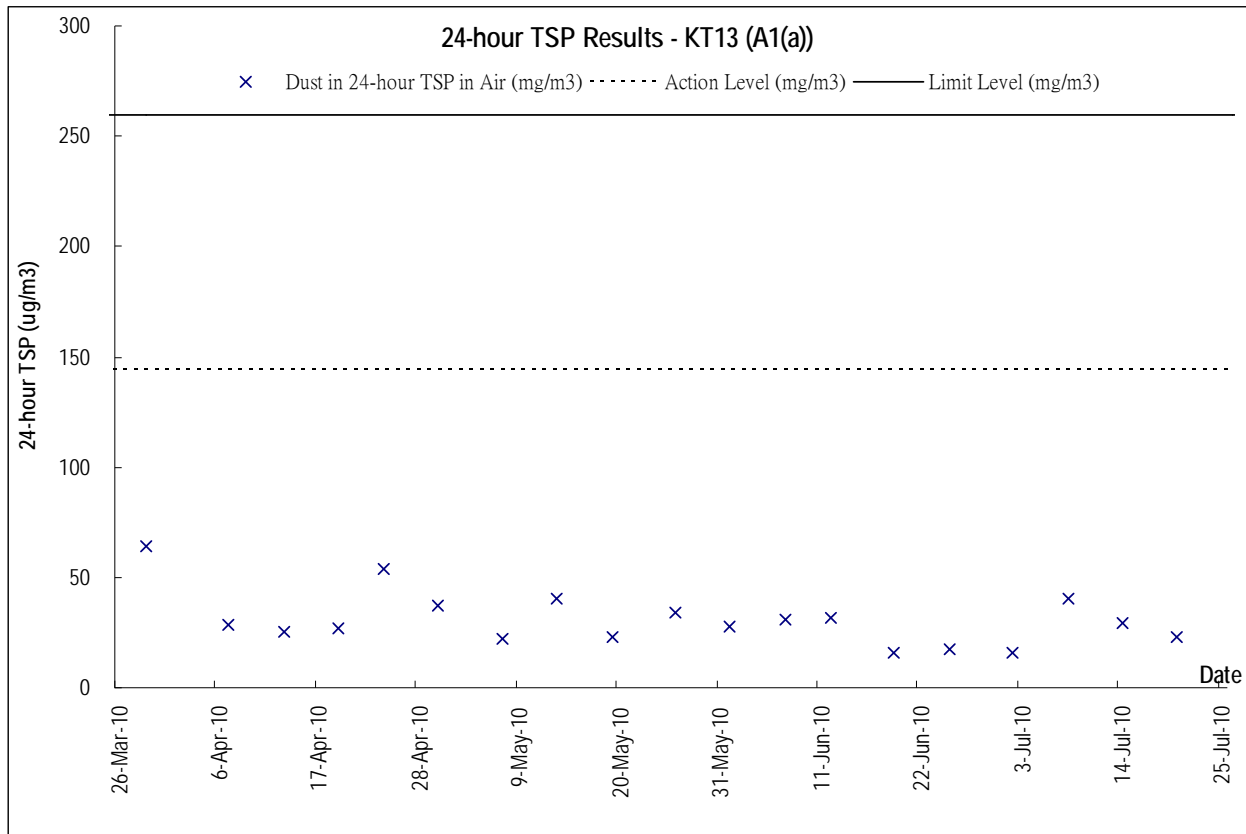

Graphic Plot of Monitoring –Water Quality

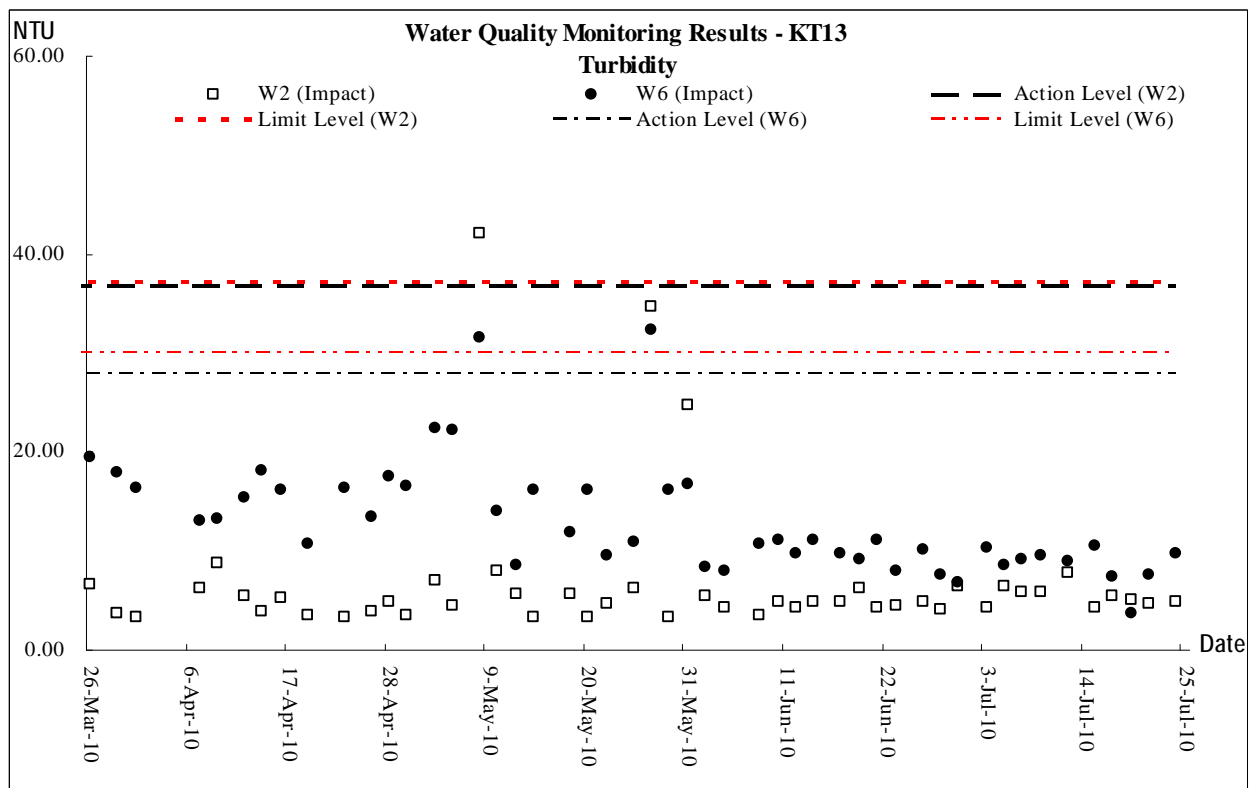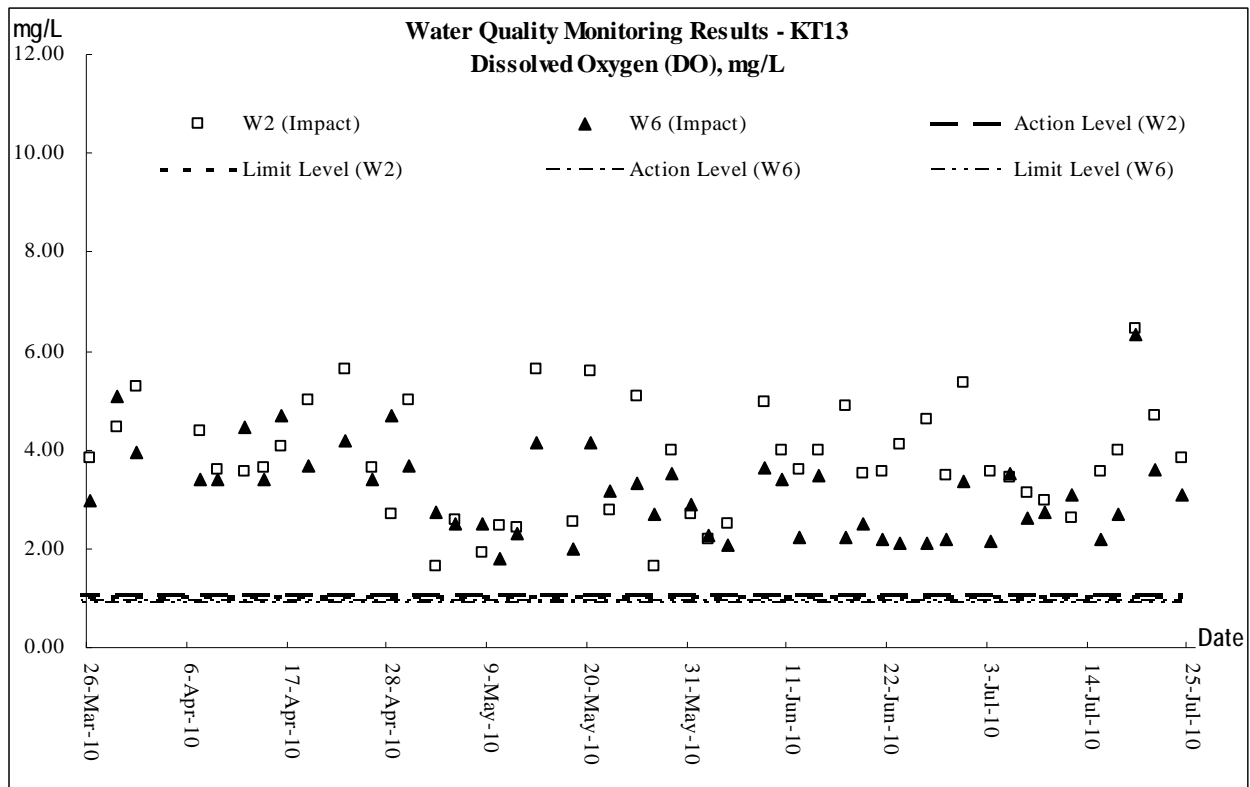

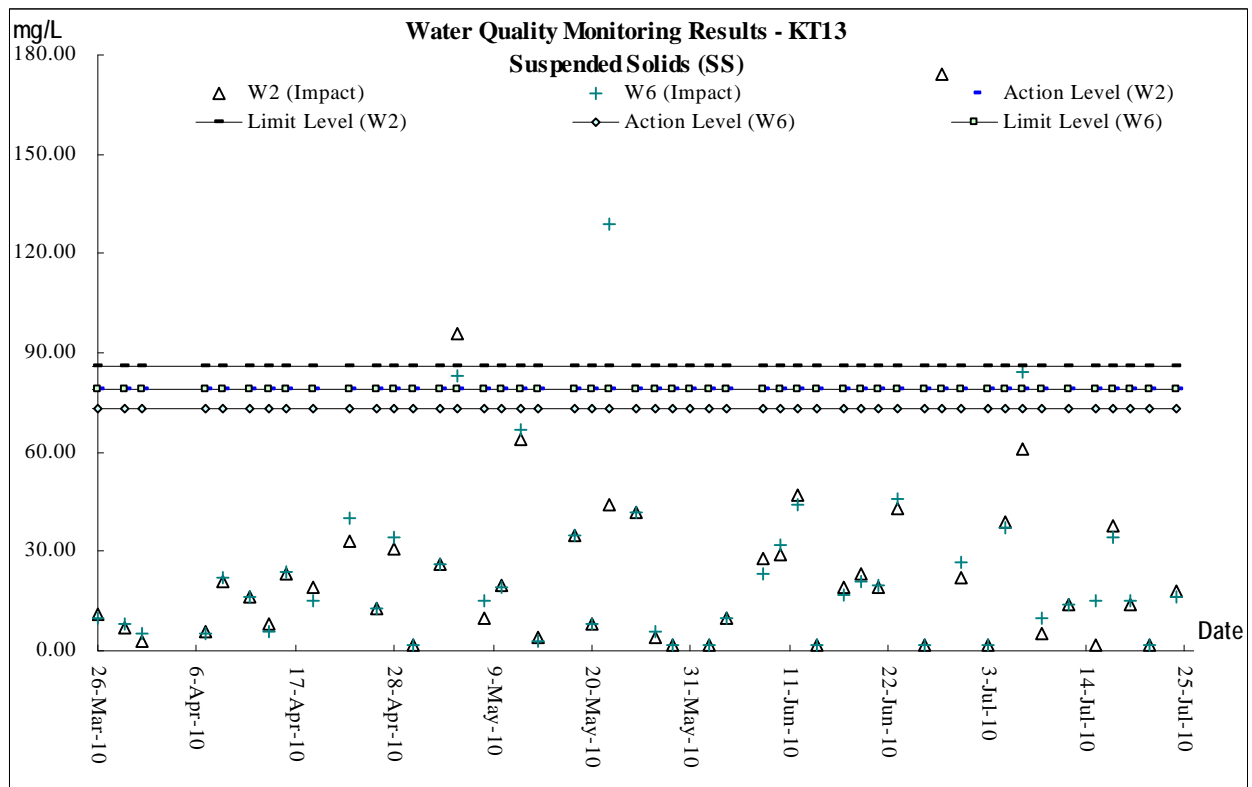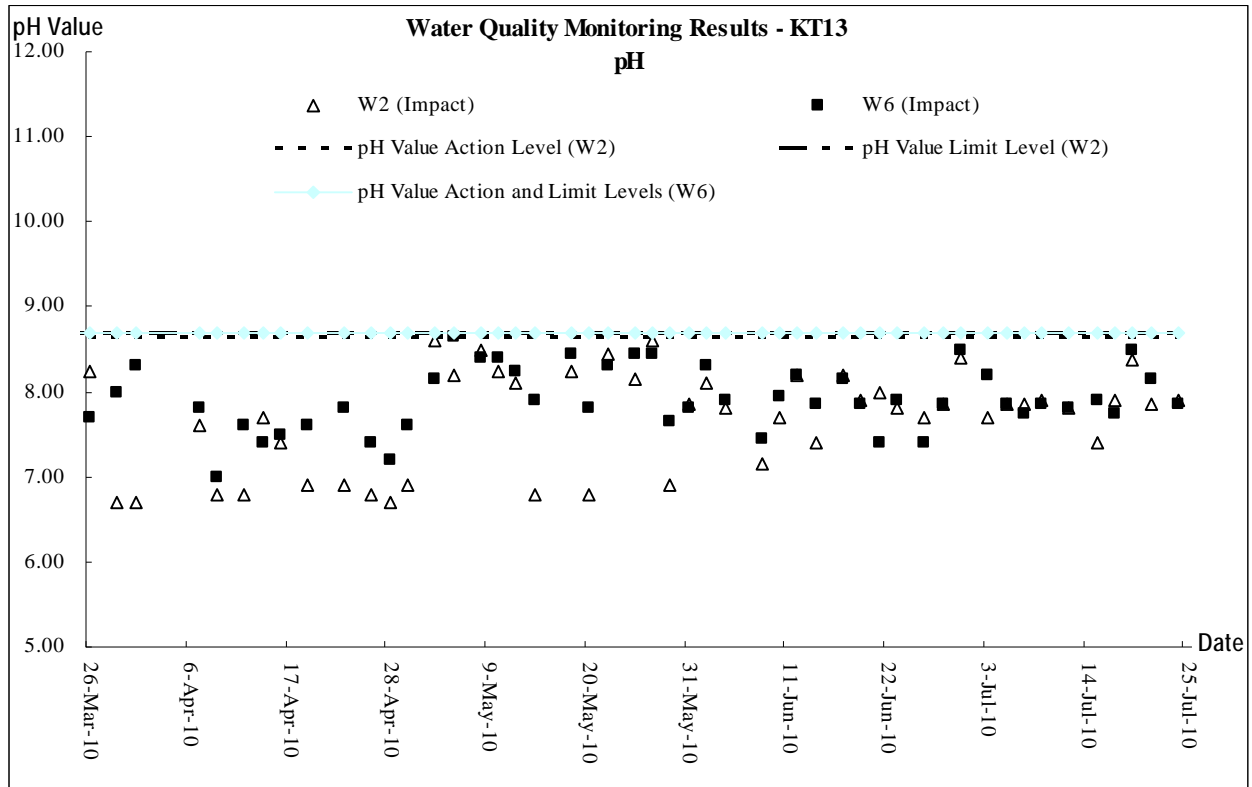

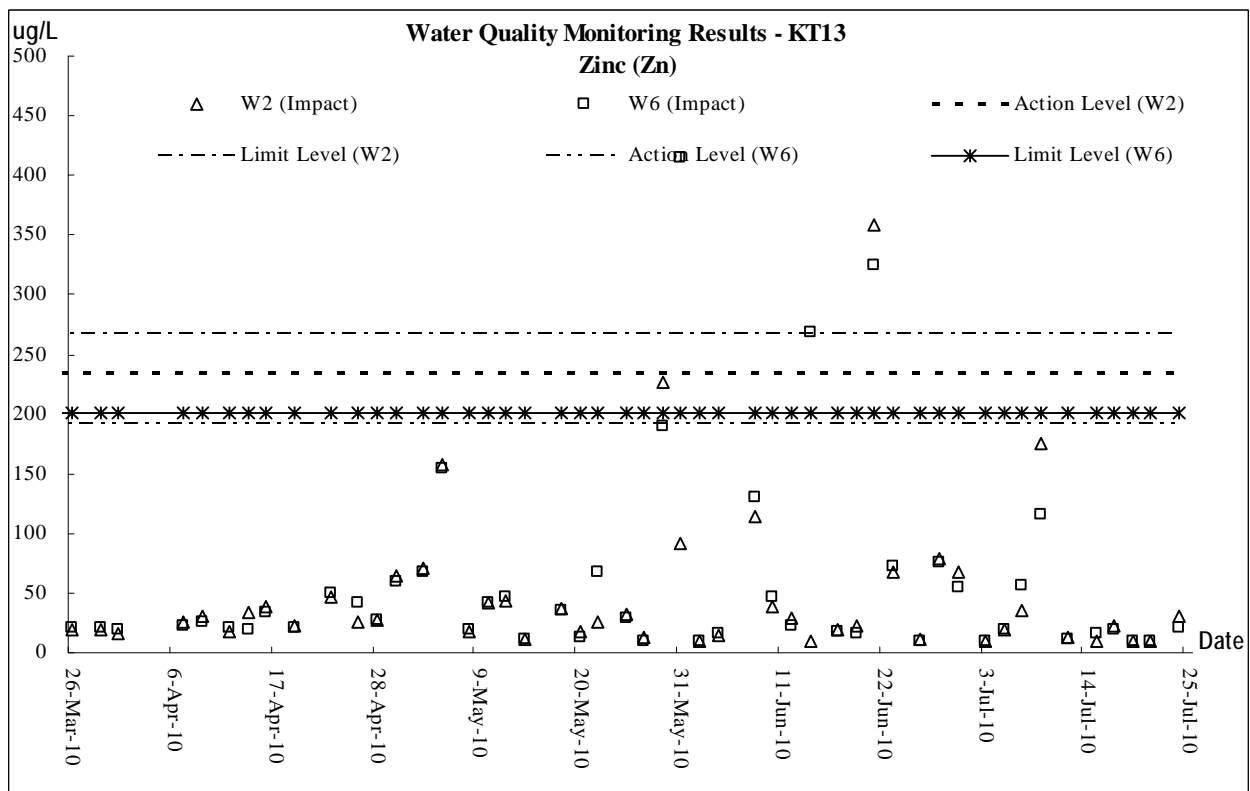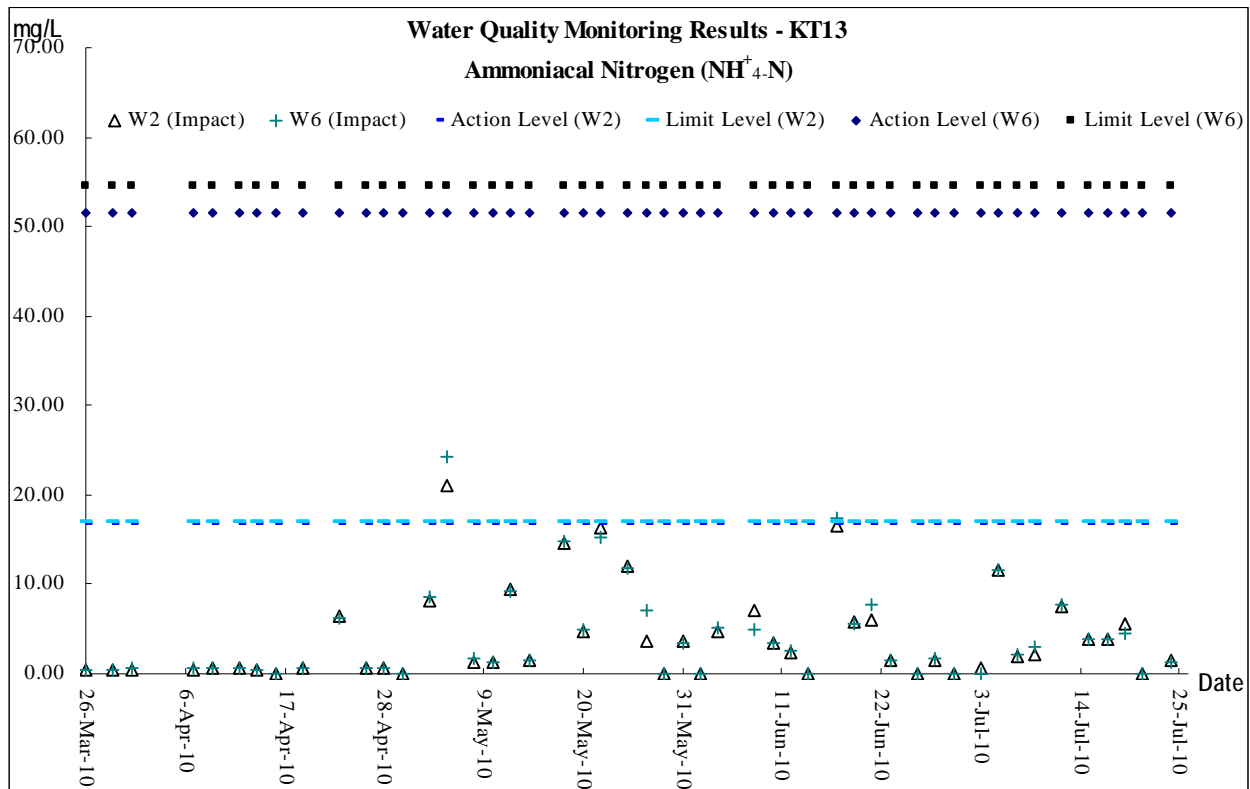

Appendix H

Photographic Records of

Ecological Monitoring of Vegetation
(Not Used)

Appendix I

Condition Survey of the Grave during Construction Phase (Not Used)

Appendix J

Physical, Human and Cultural Landscape Resources at KT13

Current Situation of Physical, Human and Cultural Landscape Resources at KT13, inspected on 06 and 19 July 2010

The physical resources that will be affected during the Construction Phase and Operational Phase, together with their sensitivity to change, are described below. The locations of the baseline landscape resources are mapped in Drawing no. LR-001. The Landscape Resources in direct conflict with the Project are mapped together with their extent outside study boundary for integrity of information. Photo views illustrating the landscape resources of the study area are illustrated in Drawing Nos. PR-001 to 002 inclusive. For ease of reference and co-ordination between text, tables and figures each landscape resources is given an identity number.

Table compares the baseline study and the current situation for KT13: (Landscape Resources)

Section in EIA Report	Identify number – Landscape Resources	Photo No	Baseline Study, Environmental Impact Assessment Final Report [382047/E/EIA/Issue 9]	Current Situation
Drainage				
10.7.3	LR1 – River/ Stream	A1 - A5	There is a semi-natural drainage features (the Ma On Kong Channel) in the study area with untrained natural upstream and partial trained downstream with a total length of 800m. The Channel originates from the South-West of the valley and discharge to the existing Primary Channel by Kam Ho Road running through and along the site area spanning across majority of the river valley, together with the existing vegetations forming the central part of riparian landscape network. They have medium landscape value and sensitive to change.	Minor change due to construction work within the site boundary.
Fish Pond				
10.7.4	LR2.1 (Fish Pond) within site boundary LR2.2 (Fish Pond) outside site boundary	A6 A7	There are 4 numbers of fallowed fish ponds at the upstream of the Ma On Kong Channel. A chain of fish ponds near downstream but distant from the Channel is noted. The fish ponds cover area of in total 23,000 m2. Most of them are heavily colonized by aquatic plants, which attribute to their low visual quality as a water landscape element. They have low landscape value and sensitive to change.	Minor change due to construction of structures within site boundary. A soil platform was

				created outside site boundary due to other project was noted.
Marsh				
10.7.5	LR3 (Marsh)	A8	It comprises 2 marshes at the upstream channel of the Channel. They are inundated lowland heavily colonized with wetland aquatic plants. They have low landscape value and sensitive to change.	Remain the same as the baseline
Vegetation				
10.7.7	LR4 (Woodland/ Wooded Area)	A9 A10	It comprises two major communities of woodland/ wooded area. One is dense natural woodland stretching across the Conservation Area and area behind Ma On Kong and consists approximate 450 numbers of trees based on visual estimation. The trees are mainly native species and mature in size. It is dominated by <i>Schefflera octophylla</i> , <i>Pinus massoniana</i> , <i>Aporosa chinensis</i> , <i>Celtis sinensis</i> , <i>Bridelia tomentosa</i> , <i>Cinnamomum cmaphora</i> , <i>Rhus chinensis</i> and <i>Phus succedaneas</i> . Another one is a natural more sparse riparian wooded area at upstream of the Channel and consists approximate 60 numbers of trees based on visual estimation. The trees are mainly pioneer species and poorer in form and maturity. It is dominated by <i>Ficus hispide</i> and <i>Macaranga tanarius</i> . They have high landscape value and sensitivity to change.	Remain the same as the baseline
10.7.8	LR5 (Orchard/ Horticultural Trees)	A11	It comprises two groups of trees at downstream below Ma On Kong and north of Ho Pui Amongst there are approximate 400 numbers of trees based on visual estimation. They are fruit trees and landscape plants of horticultural practices. It is dominated by <i>Dimocarpus longan</i> , <i>Delonix regian</i> , <i>Roystonea regia</i> and <i>Pachira macrocarpa</i> . For their anthropogenic and not permanent in nature, they have medium landscape value and sensitivity to change.	Remain the same as the baseline
10.7.9	LR6 (Low-Lying Agricultural Land/ Fallowed Land)	A12	It comprises fallowed land and agricultural land in low rate of uses. The vegetation is mainly grass and sedge with mosaics of shrubs approaching the Channel. It fills up the about half of the existing	Remain the same as the baseline.

			landscape within the study area. They have low landscape value and sensitivity to change.	
Sitting-Out Area				
10.7.10	LR7 (Sitting-Out Area at Ma On Kong)	A13	It is located at the Ma On Kong next to the access road. It is a small sitting-out area primarily hard-paved with only 3 amenity trees and on pavilion. It has low landscape value and sensitivity to change.	Remain the same as the baseline
Landscape Character Areas				
10.7.12	LCA1 (Agricultural Landscape Character Area)	B1 & B2	This comprises fallowed land & agricultural land not in active uses. This character area is flat and gentle sloping in landform and vegetated with grass of various heights. It forms the majority of the landscape character of the entire river valley and the connecting landscape element between other landscape character areas. The sensitivity to change of this area is low.	Minor change due to invasion of cows. Some of the grass on the land were consumed.
10.7.13	LCA2 (Woodland Landscape Character Area)	B3	This is natural woodland between southern Ma On Kong and the Channel extending up to the access road behind Ma On Kong. The trees are mature in size forming a close woodland landscape. It is the location of egret of conservation importance. The sensitivity to change of this area is high.	Remain the same as the baseline
10.7.14	LCA3 (River/ Stream Landscape Character Area)	B4 – B7	This is the main stream of the Channel in associate with its riparian vegetation. It meanders through the river valley landscape. It is used as a receptor of agricultural effluent from poultry farm around upstream, which contribute to the polluted appearance of the character area around upstream. The sensitivity to change of this area is medium.	Minor change due to construction work within site boundary
10.7.15	LCA4 (Fish Pond Landscape Area)	B8	This comprises a number of fish ponds of various sizes distributed about the Channel. Most of them are abandoned or with limited uses and colonized with aquatic plants. The sensitivity to change of this area is medium.	Minor change due to construction of structures within site boundary.

10.7.16	LCA5 (Village Landscape Character Area)	B9 & B10	This comprises the four major village types rural settlement encompassing tai Kek, Ma On Kong, Ho Pui and north of Ho Pui. Except Tai Kek which is less revitalized and actively resided, all other three are actively resided. This area is lightly urbanized with low rise village house. The sensitivity to change of this area is low.	Remain the same as the baseline
10.7.17	LCA6 (Industrial Landscape Character Area)	B11 & B12	This comprise collection of slummy-built temporary structure and open storage uses land, which are characterized with metallic hoarding and used for poultry, recycling, vehicle repairing etc. The sensitivity to change of this area is low.	Reconstruction of hoarding was conducted by the land owner
10.7.18	LCA7 (Nullah Landscape Character Area)	B13	This is the trained nullah next to Kam Ho Road. It is the primary tributary connecting and receiving outflow from the Ma On Kong Channel. The area is man-made and with poor and monotonous riverside vegetation. The sensitivity to change of this area is low.	Remain the same as the baseline

10.7.19 Visual Character

The visual quality of the river valley of Ma On Kong Channel is semi-natural based on combination of rural landscape elements including agricultural land, village houses, woodland and pond and stream and industrial landscape elements including open storage and temporary structures. Interspersed landscape elements on general flat landform with minor undulation render numerous small enclosed views. No major vista and high quality open view identified.

10.7.20 Visual Sensitive Receiver (VSR)

Within the ZVI, a number of key Visual Sensitive Receivers (VSRs) have been identified. These VSRs are mapped in Drawing V-001. They are listed, together with their sensitivity, in Table 10/5. Photo views illustrating the VSRs are illustrated in Drawing nos. PV-001 to 002 inclusive. For the ease of reference, each VSR is given an identity number, which is used in the text, tables and figures.

Table compares the baseline study and the current situation for KT13: (Visual Sensitive Receiver)

Section in EIA Report	Identify number – VSR	Photo No.	Baseline Study, Environmental Impact Assessment Final Report [382047/E/EIA/Issue 9]	Current Situation
Industrial VSRs				
10.7.21	I1	C1	Open storage near junction between Kam Ho Road and Village access The VSRs is workers of the open storage. The number of individual is very few and their sensitivity to visual impacts is low.	Remain the same as the baseline
10.7.22	I2	C2	Plant Nursery at the east of Ma On Kong Channel The VSRs is workers of the plant nursery. The number of individual is very few and their sensitivity to visual impacts is low.	Remain the same as the baseline
10.7.23	I3	C3	Plant Nursery at the west of Ma On Kong Channel The VSRs is workers of the plant nursery. The number of individual is very few and their sensitivity to visual impacts is low.	Temporary stockpiling was observed
10.7.24	I4	C4	Temporary Structure for poultry east to Ho Pui The VSRs is workers of the temporary structure. The number of individual is very few and their sensitivity to visual impacts is low.	Reconstruction of hoarding was conducted by the land owner
10.7.25	I5	C5	Open Storage at the end of village access road The VSRs is workers of the open storage. The number of individual is very few and their sensitivity to visual impacts is low.	
10.7.26	I6	C6	Temporary Structure for poultry and Open Storage at upstream of Ma On Kong Channel The VSRs is workers of the temporary structure and open storage. The number of individual is very few and their sensitivity to visual impacts is low.	Remain the same as the baseline

Open Space / Sitting – Out Area VSRs				
10.7.27	O1	C7	<p>Users of Sitting-out Area at Ma On Kong</p> <p>The VSRs is future users of the re-provided sitting-out area during operation phase. The number of individual is few and their sensitivity to visual impacts is medium.</p>	Remain the same as the baseline
Residential VSRs				
10.7.28	R1	C8	<p>Tai Kek</p> <p>The VSRs is residents of the village. The number of individual is very few and their sensitivity to visual impacts is high.</p>	Remain the same as the baseline
10.7.29	R2	C9	<p>North of Ma On Kong</p> <p>The VSRs is residents of the village. The number of individual is very few and their sensitivity to visual impacts is high.</p>	Remain the same as the baseline
10.7.30	R3	C10	<p>Ma On Kong</p> <p>The VSRs is residents of the village. The number of individual is very few and their sensitivity to visual impacts is high.</p>	Remain the same as the baseline
10.7.31	R4	C11	<p>North of Ho Pui</p> <p>The VSRs is residents of the village. The number of individual is few and their sensitivity to visual impacts is high.</p>	Remain the same as the baseline

Transport-related VSRs				
10.7.32	T1	C12	<p>Motorists and Pedestrians along village access road (lower section)</p> <p>The VSRs is the road users of the road section. The number of individual is few and their sensitivity to visual impacts is low.</p>	Remain the same as the baseline
10.7.33	T2	C13	<p>Motorists and Pedestrians along village access road (high section)</p> <p>The VSRs is the road users of the road section. The number of individual is very few and their sensitivity to visual impacts is low.</p>	Remain the same as the baseline
10.7.34	T3	C14	<p>Motorists, Pedestrians and Tourists along access road toward Ho Pui Reservoir</p> <p>The VSRs is the road users of the road section, part of which are tourist to Ho Pui Reservoir. The number of individual is very few and their sensitivity to change is low.</p>	Remain the same as the baseline

DC/2007/17
Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen, Tin Sam Tsuen of Yuen Long District and
Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Physical, Human and Cultural Landscape Resources Photo record

6 July 2010



Photo No. A1 – LR1

River/Stream



Photo No. A2 – LR1

River/Stream



Photo No. A3 – LR1

River/Stream



Photo No. A4 – LR1

River/Stream



Photo No. A5 – LR1

River/Stream



Photo No. A6 – LR2.1

Fish Pond within site boundary



Photo No. A7 – LR2.2

River/Stream



Photo No. A8 – LR3

River/Stream



Photo No. A9 – LR4

Woodland/Wooded Area



Photo No. A10 – LR4

Woodland



Photo No. A11 – LR5

Orchard/ Horticultural Trees



Photo No. A12 – LR6

Low-Lying Agricultural Land/ Fallowed Land



Photo No. A13 – LR7

Sitting-Out Area at Ma On Kong



Photo No. B1 – LCA1 Agricultural Landscape Character Area



Photo No. B4 – LCA3 River/ Stream Landscape Character Area



Photo No. B7 – LCA3 River/ Stream Landscape Character Area



Photo No. B2 – LCA1 Agricultural Landscape Character Area



Photo No. B5 – LCA3 River/ Stream Landscape Character Area



Photo No. B8 – LCA4 Fish Pond Landscape Area



Photo No. B3– LCA2 Woodland Landscape Character Area



Photo No. B6 – LCA3.1 River/ Stream Landscape Character Area



Photo No. B9– LCA5 Village Landscape Character Area



Photo No. B10—LCA 5 Village Landscape Character Area



Photo No. B11—LCA 6 Industrial Landscape Character Area



Photo No. B12—LCA 6 Industrial Landscape Character Area



Photo No. B13—LCA 7 Nullah Landscape Character Area



Photo No. C1-11 Open storage near junction between Kam Ho Road and Village access road



Photo No. C4-14 Temporary Structure for poultry east to Ho Pui



Photo No. C7-01 Sitting-out Area at Ma On Kong



Photo No. C2-12 Plant Nursery at the east of Ma On Kong Channel



Photo No. C5-15 Open Storage at the end of village access road



Photo No. C8-R1

Tei Kek



Photo No. C3-13 Plant Nursery at the east of Ma On Kong Channel



Photo No. C6-16 Temporary Structure for poultry and Open Storage at upstream of Ma On Kong Channel



Photo No. C9-R2

North of Ma On Kong



Photo No. C10—R3
 Ma On Kong



Photo No. C11—R4
 North of Ho Pui



Photo No. C12—T1 Motorists and Pedestrians along village access road
 (lower section)



Photo No. C13—T2
 Motorists and Pedestrians along village
 access road (high section)



Photo No. C14—T3
 Motorists, Pedestrians and Tourists along
 access road toward Ho Pui Reservoir

DC/2007/17
Drainage Improvement Works in Cheung Po, Ma On Kong, Yuen Kong San Tsuen, Tin Sam Tsuen of Yuen Long District and
Sewerage at Tseng Tau Chung Tsuen, Tuen Mun

Physical, Human and Cultural Landscape Resources Photo record

19 July 2010



Photo No. A1 – LR1 River/Stream



Photo No. A2 – LR1 River/Stream



Photo No. A3 – LR1 River/Stream



Photo No. A4 – LR1 River/Stream



Photo No. A5 – LR1 River/Stream



Photo No. A6 – LR2.1 Fish Pond within site boundary

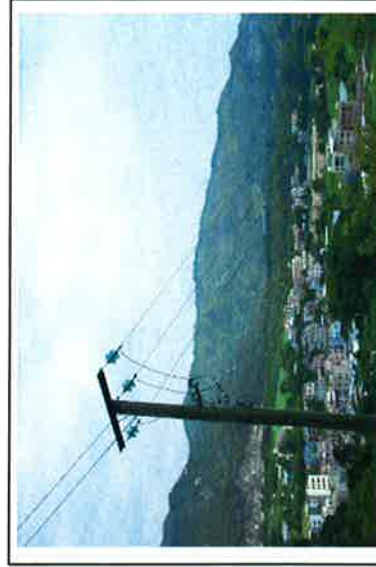


Photo No. A7 – LR2.2 River/Stream



Photo No. A8 – LR3 River/Stream



Photo No. A9 – LR4 Woodland/Wooded Area



Photo No. A10 – LR4

Woodland



Photo No. A11 – LR5

Orchard/ Horticultural Trees



Photo No. A12 – LR6

Low-Lying Agricultural Land/ Fallowed Land



Photo No. A13 – LR7

Sitting-Out Area at Ma On Kong



Photo No. B1 – LCA1 Agricultural Landscape Character Area



Photo No. B2 – LCA1 Agricultural Landscape Character Area



Photo No. B3– LCA2 Woodland Landscape Character Area



Photo No. B4 – LCA3 River/ Stream Landscape Character Area



Photo No. B5 – LCA3 River/ Stream Landscape Character Area



Photo No. B6 – LCA3.1 River/ Stream Landscape Character Area



Photo No. B7 – LCA3 River/ Stream Landscape Character Area

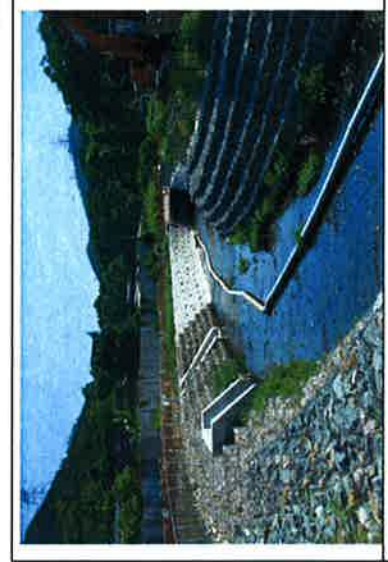


Photo No. B8 – LCA4 Fish Pond Landscape Area



Photo No. B9– LCA5 Village Landscape Character Area



Photo No. B10—LCA 5 Village Landscape Character Area



Photo No. B11—LCA 6 Industrial Landscape Character Area



Photo No. B12—LCA 6 Industrial Landscape Character Area



Photo No. B13—LCA 7 Nullah Landscape Character Area



Photo No. C1-11
 Open storage near junction between Kam
 Ho Road and Villae access road



Photo No. C4-14
 Temporary Structure for poultry east to Ho Pui



Photo No. C7-01
 Sitting-out Area at Ma On Kong



Photo No. C2-12
 Plant Nursery at the east of Ma On Kong Channel



Photo No. C5-15
 Open Storage at the end of village access road



Photo No. C8-11
 Tei Kek



Photo No. C3-13
 Plant Nursery at the east of Ma On Kong Channel



Photo No. C6-16
 Temporary Structure for poultry and Open Storage at
 upstream of Ma On Kong Channel



Photo No. C9-12
 North of Ma On Kong



Photo No. C10—R3 Ma On Kong



Photo No. C11—R4 North of Ho Pui



Photo No. C12—T1 Motorists and Pedestrians along village access road (lower section)



Photo No. C13—T2 Motorists and Pedestrians along village access road (high section)



Photo No. C14—T3 Motorists, Pedestrians and Tourists along access road toward Ho Pui Reservoir

Appendix K

Monthly Summary Waste Flow Table

Monthly Summary Waste Flow Table

Date: 31-Jul-10

Year/Month: Jul-10

Monthly Summary Waste Flow Table for July 2010										
Year	Actual Quantities of Inert C & D Materials Generated Monthly					Estimated Annual Quantities of C & D Wastes Generated Monthly				
	Total Quantity Generated	Broken Concrete (see note 4)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Metals	Paper/ Cardboard packaging	Plastics (see note 3)	Chemical Waste	Others, e.g. General refuse
	(in '000M ³)	(in '000M ³)	(in '000M ³)	(in '000M ³)	(in '000M ³)	(in '000KG)	(in '000KG)	(in '000KG)	(in '000KG)	(in '000M ³)
Jan	10.556	0.004	10.002	0.55	0	0	0	0	0	0
Feb	4.2195	0.001	4.323	-0.105	0	0	0	0	0	0
Mar	8.654	0.003	7.469	1.182	0	0	0	0	0	0
Apr	8.115	0.002	6.221	1.892	0	0	0	0	0	0
May	5.111	0.001	3.718	1.392	0	0	0	0	0	0
Jun	6.123	0.001	6.562	-0.44	0	0	0	0	0	0
Sub-Total	42.78	0.012	38.295	4.4715	0	0	0	0	0	0
Jul	7.449	0.002	8.652	-1.2045	0	0	0	0	0	0
Aug	0.000									
Sep	0.000									
Oct	0.000									
Nov	0.000									
Dec	0.000									
Total	50.227	0.014	46.946	3.267	0.000	0.000	0.000	0.000	0.000	0.000

- Notes: (1) The performance targets are given in PS Clause 28.10(14)
(2) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
(3) Plastics refer to plastic bottles/ containers, plastic sheets/ foam form packaging material
(4) Broken concrete for recycling into aggregates