

PROJECT No.: TCS/00553/11

CONTRACT NO. DC/2010/02 –
DRAINAGE IMPROVEMENT IN SHUEN WAN AND SHEK WU WAI

MONTHLY ENVIRONMENTAL MONITORING AND AUDIT REPORT (No.30) – DECEMBER 2013

PREPARED FOR KWAN LEE-KULY JOINT VENTURE

Quality Index

Date	Reference No.	Prepared By	Certified by
20 January 2014	TCS00553/11/600/R0314v1	Ben Tam (Environmental Consultant)	T.W. Tam (Environmental Team Leader)

Ver.	Date	Description
1	20 January 2014	First submission

This report has been prepared by Action-United Environmental Services & Consulting with all reasonable skill, care and diligence within the terms of the Agreement with the client, incorporating our General Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client. We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above. This report is confidential to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies upon the report at their own risk.

Ref.: DSDSHUWNEM00_0_0631L.12 ENVIRON 20 Feb 2014

Drainage Services Department Drainage Projects Division 44 & 45/F., Revenue Tower 5 Gloucester Road, Wan Chai, Hong Kong

By Fax (2827 8700) and Post

Attention; Mr. H.K.Chan and Mr. So Chi Ho

Dear Sirs,

Re: Agreement No. DP 01/2010

Services as Independent Environmental Checker for the Drainage Improvement Works in Sha Tin and Tai Po under Contract No. DC/2010/02

Monthly Environmental Monitoring and Audit Report for December 2013

Reference is made to Environment Team's submission of the Monthly Environmental Monitoring and Audit Report for December 2013 by Email on 23 January 2014 (entitled "DC/2010/22 - Monthly Impact EM&A Report (Contract 2) No.30 - December 2013").

Please be informed that we have no comment on the captioned revised report. We write to verify the captioned submission in accordance with Condition 5.4 of EP-303/2008.

Thank you very much for your kind attention and please do not hesitate to contact Mr. Max Lee (3465 - 2809) or the undersigned should you have any queries.

Yours sincerely,

Tony Cheng

Independent Environmental Checker

c.c.

AUES

Kwan Lee-Kuly JV

Attn: Mr. T. W. Tam

Attn: Mr. W. K. Chan

By Fax: 2959 6079 By Fax: 2674 6688

Q:\Projects\D\$D\$HUWNEM00\Corr\Out\D\$D\$HUWNEM00_0_0631L,12.doc

Page 1 of 1



EXECUTIVE SUMMARY

ES.01. This is the **30**th Monthly Environmental Monitoring and Audit (EM&A) Report for designated works of *DSD Contract No. DC/2010/02 - Drainage Improvement in Shuen Wan and Shek Wu Wai* (hereafter "Contract 2") under Environmental Permit No.EP-303/2008, covering a period from **1 to 31 December 2013** (hereinafter 'the Reporting Period').

ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES

ES.02. Environmental monitoring activities under the EM&A programme in this Reporting Period are summarized in the following table.

Issues	Environmental Monitoring Parameters / Inspection	Occasions
Construction	$L_{eq (30min)}$ Daytime – M2, M3 & M4	12
Noise	L _{eq (30min)} Daytime – M1 & AL1	8
	Local Stream Water Sampling – W1, W3 and W4	12
Water Quality	Local Stream Water Sampling – W2	12
water Quality	Hydrological characteristics measurement – H1 and H2	4
	Hydrological characteristics measurement – H3 and H4	4
Inspection /	Monthly Environmental Site Inspection and audit by IEC	1
Audit	Regular weekly Environmental inspection by the Contractor, ET and Site Representative Engineer	3
Ecological	Bi- monthly Ecological Monitoring	0
Landscape & Visual	Bi-weekly Inspection by a registered Landscape Architect	2

- ES.03. In this Reporting Period, no bi-monthly ecological monitoring in Area under Contract 2 was performed.
- ES.04. Landscape and visual inspection was carried on 11 and 27 December 2013 and the monthly Landscape & Visual Report (December 2013) has been signed by the registered Landscape Architect.

BREACH OF ACTION AND LIMIT (A/L) LEVELS

ES.05. No exceedance in construction noise monitoring is recorded in this Reporting Period. For water quality monitoring, a total of 65 Action/ Limit Level exceedances, namely 29 exceedances in dissolved oxygen, 22 exceedances in turbidity and 14 exceedances in suspended solids were recorded in this Reporting Period. NOEs were issued to notify EPD, IEC, the Contractor and RE upon confirmation of the results. The statistics of environmental exceedance, NOE issued and investigation result are summarized in the following table.

Environmental	Monitoring	Action	I imit	Event & Action		
Issues	Monitoring Parameters	Action Limit Level Level		NOE Issued	Investigation	Corrective Actions
Construction Noise	$L_{eq(30min)}$ Daytime	0	0	0	N.A.	N.A.
	DO	29	0	29		
Water Quality	Turbidity	5	17	22	Not project related	N.A.
	SS	3	11	14		
Hydrological	Water Flow	0	0	0	N.A.	N.A.
Characteristics	Water Depth	0	0	0	N.A.	N.A.

Note: NOE – Notification of Exceedance



SITE INSPECTION

ES.06. Weekly environmental site inspections had been carried out by the Contractor, ET and the RE on 5, 12, 17 and 27 December 2013. Furthermore, joint site inspection with the IEC was carried out on 17 December 2013. In this Reporting Period, 3 observations were recorded but no non-compliance was noted during the site inspection.

ENVIRONMENTAL COMPLAINT

ES.07. No written or verbal complaint was recorded in this Reporting Period.

NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

ES.08. No environmental summons or successful prosecutions were recorded in this Reporting Period.

REPORTING CHANGE

ES.09. No report changes were made in this Reporting Period.

FUTURE KEY ISSUES

- ES.10. During dry season, dust mitigation measures to avoid fugitive dust emissions from loose soil surface or haul road would be a key issue in coming months.
- ES.11. Special attention should be also paid on the muddy water and other water quality pollutants via site surface water runoff into the local stream Wah Ha River. As an effective water quality mitigation measure, the rock bund in the de-silting channel should be repaired regularly and ensure the de-silting performance.
- ES.12. On the other hand, construction noise should be other key environmental issue during sheet-piling process. The noise mitigation measures should be necessary to implement in accordance with EM&A Manual stipulation. Dust mitigation measures to avoid fugitive dust emissions from loose soil surface or haul road is also reminded.



TABLE OF CONTENTS

1.0	INTRODUCTION		1
	PROJECT BACKGROUND	1	
	REPORT STRUCTURE	1	
2.0	PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS AND SUBMISSION		2
	PROJECT ORGANIZATION AND MANAGEMENT STRUCTURE	2	
	CONSTRUCTION PROGRESS	2	
	SUMMARY OF ENVIRONMENTAL SUBMISSIONS	2	
3.0	EM&A PROGRAM REQUIREMENT FOR THE CONTRACT 2		3
	MONITORING PARAMETERS	3	
	MONITORING LOCATIONS	3	
	MONITORING FREQUENCY	4	
	MONITORING EQUIPMENT	5	
	MONITORING METHODOLOGY	6	
	DATA MANAGEMENT AND DATA QA/QC CONTROL	8	
	OTHERS MONITORING IMPLEMENTATION FOR THE CONTRACT	8	
	DETERMINATION OF ACTION/LIMIT (A/L) LEVELS	8	
	EQUIPMENT CALIBRATION	9	
	METEOROLOGICAL INFORMATION	9	
4.0	IMPACT MONITORING RESULTS		10
	MONITORING RESULTS SHARING	10)
	RESULTS OF CONSTRUCTION NOISE MONITORING	10)
	RESULTS OF LOCAL STREAM WATER QUALITY MONITORING	10)
	RESULTS OF HYDROLOGICAL CHARACTERISTICS MONITORING	12)
	RESULTS OF ECOLOGICAL MONITORING	13	;
5.0	WASTE MANAGEMENT		14
	RECORDS OF WASTE QUANTITIES	14	
6.0	SITE INSPECTION		15
	REGULAR SITE INSPECTION AND MONTHLY AUDIT	15	i
	LANDSCAPE AND VISUAL INSPECTION	15	i
7.0	ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE		16
	ENVIRONMENTAL COMPLAINT, SUMMONS AND PROSECUTION	16)
8.0	IMPLEMENTATION STATUS OF MITIGATION MEASURES		17
9.0	IMPACT FORCAST		21
	CONSTRUCTION ACTIVITIES FOR THE FORTH-COMING MONTH	21	
	KEY ISSUES FOR THE COMING MONTH	21	
10.0	CONCLUSIONS AND RECOMMENTATIONS		22
	CONCLUSIONS	22	
	RECOMMENDATIONS	22	



LIST OF TABLES

TABLE 2-1	STATUS OF ENVIRONMENTAL LICENSES AND PERMITS
TABLE 3-1	SUMMARY OF MONITORING PARAMETERS
TABLE 3-2	DESIGNATED MONITORING LOCATIONS OF THE EM&A PROGRAMME
TABLE 3-3	MONITORING EQUIPMENT USED IN EM&A PROGRAM
TABLE 3-4	TESTING METHOD AND DETECTION LIMIT OF SUSPENDED SOLIDS
TABLE 3-5	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE
TABLE 3-6	ACTION AND LIMIT LEVELS FOR WATER QUALITY
TABLE 3-7	ACTION AND LIMIT LEVELS FOR HYDROLOGICAL CHARACTERISTICS
TABLE 4-1	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS, dB(A)
TABLE 4-2	WATER QUALITY RESULTS SUMMARY FOR W1 & W2
TABLE 4-3	WATER QUALITY RESULTS SUMMARY FOR W3 & W4
TABLE 4-4	STATISTICS WATER QUALITY EXCEEDANCE IN THE REPORTING PERIOD
TABLE 4-5	DETAILED MONITORING RESULTS OF HYDROLOGICAL CHARACTERISTICS AT H3 AND H4
TABLE 4-6	SUMMARIZED HYDROLOGICAL CHARACTERISTICS OF WATER DEPTH, M
TABLE 4-7	SUMMARIZED HYDROLOGICAL CHARACTERISTICS OF AVERAGE VOLUMETRIC FLOW RATE
	$(Q), M^3/S$
TABLE 5-1	SUMMARY OF QUANTITIES OF INERT C&D MATERIALS
TABLE 5-2	SUMMARY OF QUANTITIES OF C&D WASTES
TABLE 6-1	SITE INSPECTION OF OBSERVATIONS – FINDINGS AND DEFICIENCIES
Table 6-2	LANDSCAPE & VISUAL INSPECTION OF OBSERVATIONS
TABLE 7-1	STATISTICAL SUMMARY OF ENVIRONMENTAL COMPLAINTS
TABLE 7-2	STATISTICAL SUMMARY OF ENVIRONMENTAL SUMMONS
TABLE 7-3	STATISTICAL SUMMARY OF ENVIRONMENTAL PROSECUTION
TABLE 8-1	ENVIRONMENTAL MITIGATION MEASURES

LIST OF APPENDICES

APPENDIX A	SITE LOCATION PLAN OF DSD CONTRACT 1 AND CONTRACT 2 AT SHUEN WAN		
APPENDIX B	ORGANIZATION CHART AND THE KEY CONTACT PERSON		
APPENDIX C	MASTER CONSTRUCTION PROGRAMS		
APPENDIX D	ENVIRONMENTAL MONITORING LOCATIONS		
APPENDIX E	CALIBRATION CERTIFICATES OF THE MONITORING EQUIPMENT AND CERTIFICATE OF ALS		
	TECHNICHEM (HK) PTY LTD		
APPENDIX F	EVENT AND ACTION PLAN		
APPENDIX G	MONITORING SCHEDULE IN REPORTING PERIOD AND COMING MONTH		
APPENDIX H	METEOROLOGICAL DATA OF REPORTING PERIOD		
APPENDIX I	DATA BASE OF MONITORING RESULT S		
APPENDIX J	GRAPHICAL PLOTS OF IMPACT MONITORING -NOISE, WATER QUALITY AND		
	HYDROLOGICAL CHARACTERISTICS		
APPENDIX K	MONTHLY SUMMARY WASTE FLOW TABLE		
APPENDIX L	MONTHLY LANDSCAPE & VISUAL INSPECTION REPORT		
APPENDIX M	ECOLOGICAL MONITORING REPORT IN AREA UNDER CONTRACT 2		



1.0 INTRODUCTION

PROJECT BACKGROUND

- 1.01 *Kwan Lee-Kuly Joint Venture* (hereinafter 'KLKJV') has been awarded by Drainage Services Department (hereinafter 'DSD') of the Contract No. DC/2010/02 Drainage Improvement in Shuen Wan and Shek Wu Wai (hereinafter 'the Project'). The Project is scheduled to commence in May 2011 and complete in March 2014 for about 35 months.
- 1.02 The works to be executed under the Project are located in Shuen Wan and Shek Wu Wai. The works mainly comprise construction of about 735 metres long single-cell box culvert along Tung Tsz Road in Shuen Wan, Tai Po and construction of about 15 m long three-cell box culvert in Shek Wu Wai, San Tin.
- 1.03 For the Project, the construction work at Tung Tsz Road Shuen Wan (hereinafter 'the Contract 2') is part of the Drainage Improvement works amongst Shatin and Tai Po and it is defined as a "Designated Project" which controlled under Environmental Permit EP-303/2008. Currently, DSD has another Contract DC/2009/22 (hereinafter 'the Contract 1') ongoing for construction at Shuen Wan working area which under the same Environmental Permit and the updated Environmental Monitoring and Audit Manual (hereinafter 'the Updated EM&A Manual'). Both DSD contract's site boundary at Shuen Wan are shown in *Appendix A*. On the other hand, Shek Wu Wai San Tin is a non-designated project work and no environmental monitoring and audit is request to carry out.
- In order to effectively implement the environmental protection measures stipulated in the Project Profile (hereinafter 'the PP'), Environmental Impact Assessment Report (hereinafter "the EIAR'), Environmental Permit EP303/2008, a corresponding EM&A Manual have been prepared to outline the environmental monitoring and auditing (hereinafter 'the EM&A') programme undertake for the Contracts 1 and 2.
- 1.05 KLKJV has commissioned Action-United Environmental Services and Consulting (AUES) as an independent environmental team (hereinafter 'the ET') to implement the EM&A program for the environmental protection of the Project. Due to the construction of Contracts 1 and 2 carry out is just about the time, a Proposal Environmental Monitoring Programme and Methodology (hereinafter the "PEMPM") was prepared and submitted to describe EM&A programme would be undertaken during construction period of the Contract 2.
- 1.06 The baseline monitoring of EM&A program has been performed by the Contract 1 ET. Although Action and Limit levels of environmental performance criteria have established by the Contract 1 ET, the Action/Limit levels re-establishment to use the Contract 2 was conducted by the Contract 2 ET. The re-established environment performance criteria has accepted by the IEC and also submitted to the EPD seek for endorsement.
- 1.07 This is the 30th Monthly EM&A Report for Contract 2 presenting the monitoring results and inspection findings for the reporting period from 1 to 31 December 2013.

REPORT STRUCTURE

- 1.08 The Monthly Environmental Monitoring and Audit (EM&A) Report is structured into the following sections:-.
 - SECTION 1 INTRODUCTION
 - SECTION 2 PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS AND SUBMISSION
 - SECTION 3 EM&A PROGRAM REQUIREMENT FOR THE PROJECT
 - SECTION 4 IMPACT MONITORING RESULTS
 - SECTION 5 WASTE MANAGEMENT
 - SECTION 6 SITE INSPECTIONS
 - SECTION 7 ENVIRONMENTAL COMPLAINTS AND NON-COMPLIANCE
 - SECTION 8 IMPLEMENTATION STATUES OF MITIGATION MEASURES
 - SECTION 9 IMPACT FORECAST
 - SECTION 10 CONCLUSIONS AND RECOMMENDATION



2.0 PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS AND SUBMISSION PROJECT ORGANIZATION AND MANAGEMENT STRUCTURE

2.01 Organization structure and contact details of relevant parties with respect to on-site environmental management are shown in *Appendix B*.

CONSTRUCTION PROGRESS

- 2.02 The master construction programs are enclosed in *Appendix C* and the major construction activities undertaken at Tung Tsz Road, Shuen Wan in this Report Period are listed below:-
 - Construction of Box Culvert Bay (3-4)
 - Installing sheetpile of box culvert at Bay (12-15)
 - Excavation of box culvert at Bay (16-19)
 - Construction of Box Culvert Bay (28-31)
 - Excavation of box culvert at Bay (32-34)
 - Excavation of box culvert at Bay (Wai Ha Intake and Bay 15)

SUMMARY OF ENVIRONMENTAL SUBMISSIONS

2.03 Summary of the relevant permits, licences, and/or notifications on environmental protection for this Project in this Reporting Period is presented in *Table 2-1*.

Table 2-1 Status of Environmental Licenses and Permits

Item	Description	License/Permit Status
1	Air Pollution Control (Construction Dust)	Notified EPD on 17 October 2011
	Chemical Waste Producer Registration (WPN5213-727-K2972-02)	Approved on 28 October 2011
3	Water Pollution Control Ordinance (Discharge License) WT00009528-2011	Valid to 31 July 2016
4	Billing Account for Disposal of Construction Waste (Account No.: 7012838)	Effective

- 2.04 The "Proposal Environmental Monitoring Programme and Methodology (R0006 Version 2)" was set out in accordance with the Updated Environmental Monitoring and Audit Manual. It was approved by the ER and agreed with the Independent Environmental Checker (IEC) and submitted to the EPD for endorsement.
- 2.05 For Contract 2 of the Project, no Baseline Monitoring Report was issued by the ETL. However, a new set of the Action/ Limit levels as used to Contract 2 were proposed by ET. It had been accepted by the IEC and also submitted to the EPD seek for endorsement.



3.0 EM&A PROGRAM REQUIREMENT FOR THE CONTRACT 2

3.01 The EM&A requirements set out in the PP, EIAR, Environmental Permit EP303/2008 (hereinafter 'the EP'), and the associated updated EM&A Manual, are presented below sub-section.

MONITORING PARAMETERS

3.02 According to the EIAR and the updated EM&A Manual, The monitoring parameters of each environmental aspect summarized in *Table 3-1* will be performed as under the Project.

Table 3-1 Summary of Monitoring Parameters

Environmental Aspect	Parameters		
Construction	<u> </u>	ent continuous sound pressure level (30min) (hereinafter	
Noise	'Leq(30min)' durin	g the normal working hours; and	
	A-weighted equival	lent continuous sound pressure level (5min) (hereinafter	
	'Leq(5min)' for cor	nstruction work during the restricted hours.	
Water Quality	• In Situ Temperature, Dissolved Oxygen, Dissolved Oxygen		
	Measurement	Saturation, pH and Turbidity	
	Laboratory	Suspended Solids (hereinafter 'SS')	
	Analysis	Analysis	
Hydrological	The water flow and depth measurement onsite		
Characteristics			
*Ecology	Monitor and audit the proper implementation of mitigation measures stipulated		
	in EIA report and the updated EM&A Manual		
Landscape &	Inspect and audit the implementation and maintenance of landscape and visual		
Visual	mitigation measures	-	

Remarks: * the monitoring is carried out by IEC

MONITORING LOCATIONS

3.03 Monitoring locations have been proposed in the updated EM&A Manual. Graphic plot to show in *Appendix D* and summarized in *Table 3-2*.

Table 3-2 Designated Monitoring Locations of the EM&A Programme

Aspect	Location ID	Address	
	M1	14, Shuen Wan Chim Uk	
Construction	AL1	Joint Village Office for Villages in Shuen Wan, Tai PO	
Noise	M2	150, San Tau Kok	
Noise	M3	31, Wai Ha	
	M4	Block 15, T rèasure Spot Garden	
	410	Between the Shuen Wan Marsh and ECA	
	^(#) W1	• Co-ordinates: E839301, N836386	
		• Existing River Bed Level: +1.75mPD).	
	W2	Between Tolo Harbour and Proposed Penstock	
		• Co-ordinates: E839542, N836184	
Water Quality		• Exiting River Bed Level: +1.48mPD)	
Water Quarty	(*) W3	Upstream of Tung Tze Shan Road	
		• Co-ordinates: E838760, N836714	
		• Exiting River Bed Level: +5.08mPD)	
		Wai Ha Village 29D	
	W4	• Co-ordinates: E838865, N836621	
		• Exiting River Bed Level: +4.05mPD)	
Hydrological	H1	Between the Shuen Wan Marsh and ECA	
	111	• Coordinates: E839306, N836379)	
Trydrological	H2	Route 10 Sam Kung Temple	
	112	• Coordinates: E839163, N836433	



Aspect	Location ID	Address	
	НЗ	Upstream of Tung Tze Shan Road Coordinates: E838760, N836714	
	H4	Wai Ha Village 29D • Coordinates: E838865, N836621	
Ecology	Areas within	hin 100m of the works boundary under Contract 2	
Landscape & Visual	As within and adjacent to the construction sites and works areas under the Contract 2,		

Remarks:

MONITORING FREQUENCY

3.04 The monitoring frequency and duration as specified in the updated EM&A Manual are summarized below.

Construction Noise

<u>Frequency</u>: Once a week during 0700-1900 on normal weekdays for $L_{eq(30min)}$

If the construction work is undertake at restricted hour, the monitoring frequency of construction noise will be conducted in accordance with the related Construction Noise Permit requirement issued by EPD as follow

- 3 consecutive $L_{eq(5min)}$ at restrict hour from 1700 2300;
- 3 consecutive L_{eq(5min)} for restrict hour from 2300 0700 next day;
- 3 consecutive L_{eq(5min)} for Sunday or public holiday from 0700 1900;

<u>Duration</u>: Throughout the construction period when the major construction activities are undertaken

Water Quality

Frequency: Three times a week. The interval between 2 sets monitoring are not less than 36

hours

Duration: During the construction phase of Contract 2 to undertake (in accordance with the

Updated EM&A Manual Section 4.27).

Hydrological Characteristics

Frequency: Once per week at mid-flood and mid-ebb tides

<u>Duration</u>: During the construction phase of Contract 2 to undertake; and one year after the

construction is complete as operation phase monitoring (in accordance with the

Updated EM&A Manual Section 4.32).

Ecology

3.05 In according with Section 6.17 of the Updated EM&A Manual, ecological monitoring should be conducted by the Independent Environmental Checker (hereinafter 'IEC'). Monitoring programme details should be agreed with the Agriculture, Fisheries and Conservation Department (AFCD). Moreover, the IEC should submit reports on the findings of each monitoring trip, and a final report summarizing the monitoring results over the entire monitoring period to AFCD and Environmental Protection Department (EPD). Hence, no monitoring or surveying should be carried out by ET of the Project.

Landscape & Visual

3.06 According to Section 7.4 of the Updated EM&A Manual, site inspection bi-weekly should be performed to check the implementation and maintenance of landscape and visual mitigation measures whether to full realize.

^(#) Control Station of Contract 1, however impact station of Contract 2

^(*) Control Station of Contract 2



MONITORING EQUIPMENT

Noise Monitoring

3.07 Sound level meter in compliance with the *International Electrotechnical Commission Publications* 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for noise monitoring. The sound level meter shall be checked with an acoustic calibrator. The wind speed shall be check with a portable wind speed meter, which capable to measure wind speed in m/s.

Water Quality Monitoring

- 3.08 **Dissolved Oxygen and Temperature Measuring Equipment** The instrument should be a portable and weatherproof dissolved oxygen (DO) measuring instrument complete with cable and sensor, and use a DC power source. The equipment should be capable of measuring DO level in the range of 0 20mg L-1 and 0 200% saturation; and temperature of 0 45 degree Celsius.
- 3.09 **pH Meter** The instrument shall consist of a potentiometer, a glass electrode, a reference electrode and a temperature-compensating device. It shall be readable to 0.1 pH in arrange of 0 to 14.
- 3.10 **Turbidity (NTU) Measuring Equipment** The instrument should be a portable and weatherproof turbidity measuring instrument using a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0 1000 NTU.
- 3.11 **Water Sampling Equipment** A water sampler should comprise a transparent PVC cylinder, with a capacity of not less than 2 litres, which can be effectively sealed with latex cups at both ends. The sampler should have a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler is at the selected water depth.
- 3.12 **Water Depth Detector** A portable, battery-operated echo sounder should be used for the determination of water depth at each designated monitoring station. The unit can either be hand held or affixed to the bottom of the work boat.
- 3.13 **Sample Containers and Storage** Water samples for SS should be stored in high density polythene bottles with no preservative added, packed in ice (cooled to 4°C without being frozen).
- 3.14 **Suspended Solids Analysis** Analysis of suspended solids shall be carried out in a HOKLAS or other international accredited laboratory.

Hydrological Characteristics

- 3.15 **Water Depth Detector** A portable, battery-operated echo sounder shall be used for the determination of water depth at each designated monitoring station.
- 3.16 **Stream water flow Equipment** –A portable, battery-operated flow meter should be used for the determination of water flow rate at each designated monitoring location and record in m³/s.
- 3.17 The monitoring equipment using for the Project's EM&A program were proposed by the ET and verified by the IEC prior commencement of the monitoring. Details of the equipment used for impact monitoring are listed in *Table 3-3*.

Table 3-3 Monitoring Equipment Used in EM&A Program

Equipment	Model	
Construction Noise		
Integrating Sound Level Meter	B&K Type 2238	
Calibrator	B&K Type 4231	
Portable Wind Speed Indicator	Testo Anemometer	
Water quality		
Water Depth Detector	Eagle Sonar	
Water Sampler	A transparent PVC cylinder / bucket	



Equipment	Model			
Thermometer & DO meter	YSI DO Meter 550A or YSI Professional Plus or YSI Sonde6820 / 650MDS			
pH meter	YSI pH10N or YSI Professional Plus or YSI Sonde 6820 / 650MDS			
Turbidimeter	Hach 2100Q or YSI Sonde 6820 / 650MDS			
Sample Container	High density polythene bottles (provided by laboratory)			
Storage Container	'Willow' 33-litre plastic cool box			
Suspended Solids	HOKLAS-accredited laboratory (ALS Technichem (HK) Pty Ltd)			
Hydrological Characteristics				
Water flow meter	GLOBAL WATER model FP211			
Water Depth Detector	Eagle Sonar or an appropriate steel ruler or rope with appropriate weight			

MONITORING METHODOLOGY

Noise Monitoring

- 3.18 Noise measurements were taken in terms of the A-weighted equivalent sound pressure level (L_{eq}) measured in decibels (dB). Supplementary statistical results (L_{10} and L_{90}) were also obtained for reference.
- 3.19 Sound level meter as listed in *Table 3-3* are complied with the *International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1)* specifications, as recommended in Technical Memorandum (TM) issued under the *Noise Control Ordinance (NCO)*.
- 3.20 During the monitoring, all noise measurements were performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}). $Leq_{(30min)}$ in six consecutive $Leq_{(5min)}$ measurements were used as the monitoring parameter for the time period between 0700-1900 hours on weekdays; and also $Leq_{(15min)}$ in three consecutive $Leq_{(5min)}$ measurements is used as monitoring parameter for other time periods (e.g. during restricted hours), if necessary.
- 3.21 During the course of measurement, the sound level meter is mounted on a tripod with a height of 1.2m above ground and placed at the assessment point and oriented such that the microphone is pointed to the site with the microphone facing perpendicular to the line of sight. The windshield is fitted for all measurements. The assessment point is normally set as free-field situation for the measurement.
- 3.22 Prior to noise measurement, the accuracy of the sound level meter is checked by an acoustic calibrator which generated a known sound pressure level at a known frequency. The checking was performed before and after the noise measurement.

Water Quality

- 3.23 Water quality monitoring are conducted at the depth below:-
 - Three depths: 1m below water surface, 1m above river bed and at mid-depth when the water depth exceeds 6m, or
 - If the water depth is between 3m and 6m, two depths: 1m below water surface and 1m above river bed, and or
 - If the water depth is less than 3m, 1 sample at mid-depth is taken
- 3.24 Water depths are determined prior to measurement and sampling, using a portable battery operated depth detector, brand named 'Eagle Sonar', if the depths exceed 1.5 meter. If the depth between 1.5 meter and 1 meter, plastic tape measurement tied with appropriate weight are used the depth estimation. For the depth well below 1 meter, an appropriate steel ruler or rope with appropriate weight are used for the depth measurement.



- 3.25 A transparent PVC cylinder, with a capacity of not less than 2 litres, is used for water sampling. The water sampler is lowered into the water body at a predetermined depth. The trigger system of the sampler is activated with a messenger and opening ends of the sampler are closed accordingly then the sample of water is collected. If the water depth is less than 500mm, a water bucket is be used as a water sampler to minimize the possibility of the latching system disturbing sediment during water sampling
- 3.26 A portable YSI DO Meter 550A or YSI Professional Plus is used for in-situ DO measurement. The DO meter is capable of measuring DO in the range of 0 20 mg/L and 0 200 % saturation and checked against water saturated ambient air on each monitoring day prior to monitoring. Although the DO Meter automatically compensates ambient water temperature to a standard temperature of 20°C for ease of comparison of the data under the changing reality, the temperature readings of the DO Meter are be recorded in the field data sheets. The equipment calibration is performed on quarterly basis.
- 3.27 A portable YSI pH10N Meter or or YSI Professional Plus is used for in-situ pH measurement. The pH meter is capable of measuring pH in the range of 0 14 and readable to 0.1. Standard buffer solutions of pH 7 and pH 10 are used for calibration of the instrument before and after measurement. The equipment calibration is performed on quarterly basis.
- 3.28 A portable Hach 2100Q Turbidity Meter is be used for in-situ turbidity measurement. The turbidity meter is capable of measuring turbidity in the range of 0 1000 NTU. The equipment calibration is performed on quarterly basis.
- 3.29 Water samples are contained in screw-cap PE (Poly-Ethylene) bottles, which are provided and pretreated and 'PE' (Poly-Ethylene) sampling bottles provided and pre-treated according to corresponding analytical requirements. Where appropriate, the sampling bottles are rinsed with the water to be contained. Water sample is then transferred from the sampler to the sample bottles.
- 3.30 One liter or 500 mL water sample are collected from each depth for SS determination. The collected samples are stored in a cool box maintained at 4°C and delivered to laboratory upon completion of the sampling by end of each sampling day.
- 3.31 All water samples are analyzed with Suspended Solids (SS) as specified in the updated *EM&A Manual* by a local HOKLAS-accredited testing laboratory (ALS Technichem (HK) Pty Ltd HOKLAS registration no. 66). SS are determined by the laboratory upon receipt of the water samples using HOKLAS accredited analytical method. The detection limits and testing method are shown below in *Table 3-4*. The certificate of ALS Technichem (HK) Pty Ltd is provided in *Appendix E*.

Table 3-4 Testing Method and Detection limit of Suspended Solids

Determinant	Testing Method	Detection Limit
Suspended solid	Determination use HOKLAS accredited analytical methods namely ALS Method EA-025 (based on APHA 2540 D)	2mg/L

Hydrological Characteristics

- 3.32 A portable, water flow meter, brand named "GLOBAL WATER model FP211" are used to determine the water current flow at the designated monitoring stations. A water flow velocity is measured at mid depth of current water body or 0.5m below water level.
- 3.33 Water depths are determined prior to measurement, using a portable battery operated depth detector, brand named 'Eagle Sonar', if the depths exceed 1.5 meter. If the depth between 1.5 meter and 1 meter, plastic tape measurement tied with appropriate weight are used the depth estimation. For the depths well below 1 meter, an appropriate steel ruler or rope with appropriate weight are used for the depth measurement.



DATA MANAGEMENT AND DATA QA/QC CONTROL

- 3.34 The impact monitoring data are handled by the ET's systematic data recording and management, which complies with in-house Quality Management System. Standard Field Data Sheets (FDS) are used in the impact monitoring program.
- 3.35 The monitoring data recorded in the equipment e.g. noise meter and Multi-parameter Water Quality Monitoring System are downloaded directly from the equipment at the end of each monitoring day. The downloaded monitoring data are input into a computerized database properly maintained by the ET. The laboratory results are input directly into the computerized database and QA/QC checked by personnel other than those who input the data. For monitoring activities require laboratory analysis, the local laboratory follows the QA/QC requirements as set out under the HOKLAS scheme for all laboratory testing.

OTHERS MONITORING IMPLEMENTATION FOR THE CONTRACT

Ecology

3.36 Ecological monitoring and reporting should be performed by IEC. No equipment and procedure are presented in the EM&A Monthly Report.

Landscape and Visual

3.37 A registered Landscape Architect as member of the ET is employed by the Contractor to undertake site inspection. Site inspection will undertake at least once every two weeks throughout the construction period to ensure compliance with the intended aims of the mitigation measures are proposed in the EIA and the updated EM&A Manual, implemented by the Contractor.

DETERMINATION OF ACTION/LIMIT (A/L) LEVELS

3.38 The re-established performance criteria for construction noise, water quality and hydrological, namely Action and Limit levels is used for Contract 2 are listed in *Tables 3-5*, *3-6*, and *3-7*.

Table 3-5 Action and Limit Levels for Construction Noise

Location	Time Period	Action Level in dB(A)	Limit Level in dB(A)
	Daytime 0700 – 1900 hrs on normal weekdays	When one	75* dB(A)
M1, AL1, M2, M3, M4	1900 – 2300 on all days and 0700 – 2300 on general holidays (including Sundays	documented complaint is	60/65/70 dB(A)**
	2300 – 0700 on all days	received	45/50/55 dB(A)**

Note: * Reduces to 70dB(A) for schools and 65dB(A) during the school examination periods.

Table 3-6 Action and Limit Levels for Water Quality

Donomoton	Performance	I	mpact Station	n
Parameter	Criteria	W1	W2	W4
DO Concentration (mg/L)	Action Level	7.27	7.26	9.27
DO Concentration (mg/L)	Limit Level	4.00	4.00	4.00
all	Action Level	NA	NA	NA
pН	Limit Level	6 - 9	6 - 9	6 - 9
Tumbidity (NTII)	Action Level	4.77	2.46	3.32
Turbidity (NTU)	Limit Level	5.26	3.42	4.52
Suspended Solids (mg/L)	Action Level	9.73	8.89	6.98
Suspended Solids (mg/L)	Limit Level	10.77	9.75	7.66

Notes:

^{**} To be selected based on the Area Sensitivity Rating of A/B/C, and the conditions of the applicable CNP(s) must be followed



- The proposed Action/Limit Levels of DO are established to be used 5%-ile/1%-ile of all the baseline data:
- The proposed Action/Limit Levels of Turbidity and SS are established to be used 95%-ile/99%-ile of all the baseline data;
- For DO, non-compliance of the water quality limits occur is when monitoring result lower than the action/limit levels:
- For turbidity and SS, non-compliance of the water quality limits occurs is when monitoring result higher than the limits; and
- For pH, non-compliance of the quality limit occur is when monitoring result lower than 6 and higher than 9; and
- All the figures given in the table are used for reference only and the EPD may amend the figures whenever it is considered necessary

Table 3-7 Action and Limit Levels for Hydrological Characteristics

Parameter	Acceptance	Monitoring Station				
Parameter	Criteria	H1	H2			
Water Depth	Action Level	0.08 (80% of baseline water depth)	0.40 (80% of baseline water depth)			
(m)	Limit Level	0.06 (60% of baseline water depth)	0.30 (60% of baseline water depth)			
Volumetric	Action Level	120% of control station's water flow rate on the same day of measurement				
Flow Rate (Q), m ³ /s	Limit Level	140% of control station's water flow rate on the same day of measurement	140% of control station's water flow rate on the same day of measurement			

- 3.39 The locations H3 and H4 are a reference measurement point in order to monitor any changes in the hydrological characteristics of Wai Ha River arising from the work Contract 2 to affect the Shuen Wan Marsh.
- 3.40 Should non-compliance of the environmental quality criteria occurs, remedial actions will be triggered according to the Event and Action Plan enclosed in *Appendix F*.

EQUIPMENT CALIBRATION

- 3.41 The sound level meter and calibrator are calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme in yearly basis.
- 3.42 All the water quality monitoring equipment such as the DO, pH and Turbidity meters are calibrated by HOKLAS accredited laboratory of three month intervals.
- 3.43 A portable, water flow meter, brand named "GLOBAL WATER model FP211" is calibrated in yearly basis.
- 3.44 All updated calibration certificates of the monitoring equipment used for the impact monitoring program in this Reporting Period are attached in *Appendix E*.

METEOROLOGICAL INFORMATION

3.45 The meteorological information during the construction phase is obtained from Tai Po and Shatin Stations of the Hong Kong Observatory (HKO). The meteorological data during the impact monitoring days are summarized in *Appendix H*



4.0 IMPACT MONITORING RESULTS

4.01 The monitoring schedule had been issued to relevant parties before each Reporting Period which presented in *Appendix G*. The works undertaken during the Reporting Period are illustrated in *Appendix C*. The monitoring results are presented in the following sub-sections.

MONITORING RESULTS SHARING

4.02 Environmental Permit EP-203/2008 was issued on 25 February 2008 by EPD which adopted for both Contracts 1 and 2 of DSD construction at Shuen Wan. Also, the EM&A programme of both contracts are undertaken in accordance with the same updated EM&A Manual which has to be carried out during construction period. According to the updated EM&A manual, designated monitoring Locations M1 and AL1 for noise monitoring stations, Locations W1 and W2 for water quality monitoring stations, and Locations H1 and H2 for hydrological measurement are requested to perform at both Contracts 1 and 2. Since Contract 1 has already commenced in January 2011, those results measured by Contract 1 would be shared for the Contract 2. This recommendation has been accepted by IEC and submitted to EPD.

RESULTS OF CONSTRUCTION NOISE MONITORING

4.03 In this Reporting Period, the noise monitoring results at the designated locations M1, AL1, M2, M3 and M4 are summarized in *Table 4-1*. The detail monitoring data are presented in *Appendix I*. The graphical plot is shown in *Appendix J*.

Table 4-1 Summary of Construction Noise Monitoring Results, dB(A)

Date	$L_{ m eq(30m)}$	in) (dB(A)	Doto	$L_{eq(30min)}(dB(A)$			
	M1 ^(#)	AL1 ^(#)	Date	M2 ^(*)	M3 ^(*)	M4 ^(*)	
4-Dec-13	63.6	68.5	6-Dec-13	67.2	71.1	59.9	
11-Dec-13	64.5	67.4	13-Dec-13	64.6	66.9	53.4	
18-Dec-13	61.3	68.8	18-Dec-13	70.2	69.0	64.1	
27-Dec-13	63.5	69.5	27-Dec-13	71.7	68.5	55.7	
Limit Level	75 dB(A)						

Remarks:

- (#) The monitoring is undertaken under façade situation. No façade correction is added according to acoustical principles and EPD guidelines.
- The monitoring is undertaken under free field situation. A façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines
- 4.04 The sound meter was set in a free field situation at the designated monitoring locations M2, M3 and M4, therefore, a façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines. For Location A1 and AN1, the monitoring is undertaken under façade situation. No façade correction is added according to acoustical principles and EPD guidelines.
- 4.05 No noise complaint (which is an Action Level exceedance) was received in this Reporting Period. As shown in *Table 4-1*, all the noise monitoring result are well below 75dB(A) and no Action or Limit Level exceedance was triggered during this Reporting Period. The graphical plot is shown in *Appendix J*.

RESULTS OF LOCAL STREAM WATER QUALITY MONITORING

- 4.06 In this Reporting Period, **12** sampling days at W1, W2, W3 and W4 were performed at designated measurement Points for local stream water quality monitoring. The monitoring results including in-situ measurements and laboratory testing results are provided in *Appendix I*. The graphical plots are shown in *Appendix J*.
- 4.07 Monitoring results of 3 key parameters: dissolved oxygen (DO), turbidity and suspended solids in this Reporting Period, are summarized in *Tables 4-2 and 4-3*.



Table 4-2 Water Quality Results Summary for W1 & W2

Compling]	DO (mg/L)		Turb	idity (NT	U)		SS (mg/L)	
Sampling date	W1 (ebb)	W1 (flood)	W2	W1 (ebb)	W1 (flood)	W2	W1 (ebb)	W1 (flood)	W2
2-Dec-13	7.83	6.20	7.38	4.7	4.6	3.3	5.00	5.00	2.60
4-Dec-13	8.46	8.40	7.47	3.8	3.5	2.8	4.00	4.00	1.40
6-Dec-13	7.69	6.43	7.21	<u>15.7</u>	<u>15.5</u>	3.9	16.00	<u>16.00</u>	<u>11.00</u>
9-Dec-13	7.08	6.78	6.98	4.6	3.1	<u>4.5</u>	6.00	4.00	12.00
11-Dec-13	8.01	7.10	7.89	4.0	4.5	<u>3.5</u>	4.00	4.00	9.40
13-Dec-13	6.22	5.10	7.16	4.5	3.9	<u>4.1</u>	8.00	7.00	3.80
16-Dec-13	7.14	5.90	7.21	18.6	<u>23.1</u>	3.6	13.00	26.00	3.80
18-Dec-13	8.37	7.25	7.31	3.6	4.5	3.1	3.00	9.00	2.20
20-Dec-13	6.15	6.76	7.21	1.8	1.6	<u>3.5</u>	2.00	2.00	5.00
23-Dec-13	7.92	6.15	7.16	4.0	3.8	3.5	8.00	8.00	3.80
27-Dec-13	9.75	8.78	8.11	6.4	<u>11.6</u>	3.1	10.00	12.00	2.00
30-Dec-13	7.63	7.96	7.34	3.0	3.9	<u>4.5</u>	2.00	3.00	2.60

[•] Bold and Italic is indicated exceeded Action Level; Bold with underline is indicated exceeded Limit Level

Table 4-3 Water Quality Results Summary for W3 & W4

Sampling	DO (1	mg/L)	Turbidit	y (NTU)	SS (mg/L)
date	W3	W4	W3	W4	W3	W4
2-Dec-13	8.05	8.51	2.17	3.12	4.00	3.00
4-Dec-13	6.24	6.87	2.73	1.76	3.00	3.00
6-Dec-13	7.90	9.09	3.43	2.33	2.00	3.00
9-Dec-13	8.67	8.82	2.15	2.56	2.00	2.00
11-Dec-13	8.12	8.67	8.00	10.50	9.00	9.00
13-Dec-13	9.26	8.94	1.13	9.46	5.00	7.00
16-Dec-13	9.26	9.65	9.51	<u>9.16</u>	8.00	26.00
18-Dec-13	8.99	9.16	2.82	3.24	2.00	3.00
20-Dec-13	6.18	5.54	20.85	3.18	12.00	10.00
23-Dec-13	7.17	7.33	5.62	4.23	10.00	9.00
27-Dec-13	9.61	11.76	1.75	2.03	5.00	5.00
30-Dec-13	7.64	8.58	1.16	2.40	2.00	2.00

Bold and Italic is indicated exceeded Action Level; Bold with underline is indicated exceeded Limit Level

- 4.08 During the Reporting Period, field measurements showed that stream water temperatures were within 12.1° C to 23.5° C and pH values within 6.25 to 9.07.
- 4.09 A statistics of exceedances for the three parameters: dissolved oxygen (DO), turbidity and suspended solids are shown in *Table 4-4*.

Table 4-4 Statistics Water Quality Exceedance

Station	D	DO		Turbidity		SS		Total Exceedance	
	Action	Limit	Action	Limit	Action	Limit	Action	Limit	
W1	13	0	0	6	1	5	14	11	
W2	6	0	4	8	1	2	11	10	
W4	10	0	1	3	1	4	12	7	
No. of Exceedance	29	0	5	17	3	11	37	28	

4.10 As shown in *Table 4-4*, a total of 65 Action/ Limit Level exceedances, namely 29 exceedances in dissolved oxygen, 22 exceedances in turbidity and 14 exceedances in suspended solids were recorded in this Reporting Period. NOEs were issued to notify EPD, IEC, the Contractor and RE upon confirmation of the results.



- 4.11 According to site information provided by the Contractor, the site activities undertaken on site included installing sheetpile in Box Culvert Bays 16 19 & 32-34 and excavation at Bays 3 4 & 28 31.
- 4.12 The active construction activities may increase the turbidity and suspended solids levels of the stream by washed out from stockpiles of dusty materials, excavated surface or dusty haul roads. To minimize the impact to the existing stream, precautionary measures such as sedimentation pit and temporary artificial precipitation stream to remove the suspended solids from wastewater have been implemented on-site. During regular site inspection with RE and Contractor, the implemented water quality mitigation measures are considered as moderate with the needed of regular maintenance. The investigation results for the exceedances are summarized as follows:
 - For the DO exceedances, the construction activities comprised none of DO depleting characteristics. Therefore, it is considered that all the DO exceedances were due to natural variation of the stream and not related to the works under the Project.
 - For the turbidity and SS exceedances recorded at W4 on 16 December 2013, it is noted that exceedances were recorded during rainy day. It is concluded that the exceedances were partially due to the Project. The Contractor should enhance the water quality mitigation measures such as covering all exposed slopes to prevent surface runoff and improve the desilting facilities as far as practicable. For the monitoring dated 11, 13, 20 & 23 December 2013 the turbidity and SS level is close to the control point W3, therefore it is considered that the SS exceedabce were due to natural variation of the stream and not related to the works under the Project.
 - For monitoring points W1, it is noted that the water quality at W1 was affected by marine water that comes from the Tolo Harbour during flood tide. Therefore, it is considered that the exceedances in W1 were not related to the works under the Project.
- 4.13 KLKJV is reminded to fully implement the required water quality mitigation measures in accordance with the updated EM&A Manual stipulation during construction under the Project. In particular when excavation and the associated box culvert construction works are undertaken near Wai Ha River, all construction wastewater or runoff generated from work area should be treated and drained to the designated discharge point. Moreover, as an effective water quality mitigation measure, the rock bund in the de-silting channel should be repaired regularly and ensure the de-silting performance.

RESULTS OF HYDROLOGICAL CHARACTERISTICS MONITORING

4.14 In this Reporting Period, hydrological characteristics measurement at were carried out on 6, 13, 20 and 27 December 2013. The monitoring data of H1 and H2 provided by DC/2009/22 is showed *Appendix I*. The detailed H3 and H4 measurement results in this Reporting Period are presented in *Tables 4-5*.

Table 4-5 Detailed monitoring results of hydrological characteristics at H3 and H4

Date	Measurement Time	Tide Condition	River Width (m)	Water Depth (m)	Cut Section (m ²)	Velocity Flow Rate (m/s)	Average Volumetric Flow Rate (Q), m ³ /s
Measureme	ent Point: H3						
6 Dag 12	10:18	Flood	7.45	0.062	0.4619	0.62	0.286
6-Dec-13	13:38	Ebb	7.45	0.058	0.4321	0.78	0.337
13-Dec-13	15:52	Flood	7.45	0.081	0.6035	0.29	0.175
13-Dec-13	9:24	Ebb	7.45	0.076	0.5662	0.25	0.142
20-Dec-13	9:00	Flood	7.45	0.152	1.1324	0.18	0.204
20-Dec-13	13:01	Ebb	7.45	0.087	0.6482	1.43	0.927
27-Dec-13	16:38	Flood	7.45	0.053	0.3949	0.3	0.118
21-Dec-13	9:30	Ebb	7.45	0.05	0.3725	0.17	0.063
Measureme	ent Point: H4		•		•		



Date	Measurement Time	Tide Condition	River Width (m)	Water Depth (m)	Cut Section (m ²)	Velocity Flow Rate (m/s)	Average Volumetric Flow Rate (Q), m ³ /s
6 Dag 12	10:35	Flood	2.74	0.079	0.2165	0.9	0.195
6-Dec-13	13:46	Ebb	2.74	0.078	0.2137	0.85	0.182
13-Dec-13	16:07	Flood	2.74	0.091	0.2493	0.24	0.060
13-Dec-13	9:39	Ebb	2.74	0.071	0.1945	0.19	0.037
20-Dec-13	9:15	Flood	2.74	0.064	0.1754	0.27	0.047
20-Dec-13	13:17	Ebb	2.74	0.05	0.1370	0.42	0.058
27-Dec-13	16:43	Flood	2.74	0.075	0.2055	0.1	0.021
21-Dec-13	9:41	Ebb	2.74	0.049	0.1343	0.09	0.012

4.15 Hydrological characteristics results of the all measurement points are summarized in *Tables 4-6* and *4-7*.

Table 4-6 Summarized Hydrological Characteristics of Water Depth, m

Doto		Mid-	Flood		Mid-Ebb			
Date H1	H1	H2	Н3	H4	H1	H2	Н3	H4
6-Dec-13	0.36	0.24	0.06	0.90	0.36	0.24	0.06	0.85
13-Dec-13	0.48	0.48	0.08	0.24	0.24	0.3	0.08	0.19
20-Dec-13	0.48	0.36	0.15	0.27	0.3	0.36	0.09	0.42
27-Dec-13	0.36	0.48	0.05	0.10	#	#	0.05	0.09

[#] No data was provided by Contract 1.

Table 4-7 Summarized Hydrological Characteristics of Average Volumetric flow rate (Q), m³/s

Doto		Mid-	Flood			Mid	-Ebb	
Date	H1	H2	Н3	H4	H1	H2	Н3	H4
6-Dec-13	0.3	1.507	0.29	0.19	0.225	1.507	0.34	0.18
13-Dec-13	0.225	1.507	0.18	0.06	0.3	1.507	0.14	0.04
20-Dec-13	0.225	1.507	0.20	0.05	0.15	1.13	0.93	0.06
27-Dec-13	0.15	1.13	0.12	0.02	#	#	0.06	0.01

[#] No data was provided by Contract 1.

4.16 To compare the monitoring data between the Reporting Period (rainy season) and baseline monitoring period, the currently water depth and volumetric flow rate has insignificant changed. Furthermore, water depth and water flow rate were found no exceedance in this Reporting Period.

RESULTS OF ECOLOGICAL MONITORING

- 4.17 According to updated EM&A Manual Section 6.17, bi-monthly ecological monitoring is conducted by the IEC ENVIRON Hong Kong Limited. In brief, the monitoring tasks include regular check on the retained and transplanted trees and shrubs, monitoring on fauna groups and aquatic fauna within the works area and any ecologically sensitive area within 100 m of the works boundary.
- 4.18 In this Reporting Period, no ecological monitoring in Area under Contract 2 is performed.



5.0 WASTE MANAGEMENT

5.01 Waste management was carried out by an on-site Environmental Officer or an Environmental Supervisor from time to time.

RECORDS OF WASTE QUANTITIES

- 5.02 All types of waste arising from the construction work are classified into the following:
 - Construction & Demolition (C&D) Material;
 - Chemical Waste;
 - General Refuse; and
 - Excavated Soil.
- 5.03 The quantities of waste for disposal in this Reporting Period are summarized in *Table 5-1* and *5-2* and the Monthly Summary Waste Flow Table is shown in *Appendix K*. Whenever possible, materials were reused on-site as far as practicable.

Table 5-1 Summary of Quantities of Inert C&D Materials

Type of Waste	Quantity	Disposal Location
C&D Materials (Inert) (m ³)	0	-
Reused in this Contract (Inert) (m ³)	0	-
Reused in other Projects (Inert) (m ³)	0	-
Disposal as Public Fill (Inert) (m ³)	333	Tuen Mun Area 38

Table 5-2 Summary of Quantities of C&D Wastes

Type of Waste	Quantity	Disposal Location
Recycled Metal (kg)	0	-
Recycled Paper / Cardboard Packing (kg)	0	-
Recycled Plastic (kg)	0	-
Chemical Wastes (kg)	0	-
General Refuses (m ³)	0.45	Local refuse station

5.04 To control over the site performance on waste management, the Contractor shall ensure that all solid and liquid waste management works are in full compliance with the relevant license/permit requirements, such as the effluent discharge license and the chemical waste producer registration. The Contractor is also reminded to implement the recommended environmental mitigation measures according to the EM&A Manual based on actual site conditions.



6.0 SITE INSPECTION

REGULAR SITE INSPECTION AND MONTHLY AUDIT

- According to the Updated Environmental Monitoring and Audit Manual, regular site inspection to evaluate the project environmental performance should be carried out during construction phase. Weekly environmental site inspections had been carried out by the Contractor, ET and RE on 5, 12, 17 and 27 December 2013. Also, joint site inspection with the IEC was carried out on 17 December 2013. In this Reporting period, 3 observations were recorded but no non-compliance was noted.
- 6.02 Observations for the site inspection and monthly audit within this Reporting Period are summarized in *Table 6-1*.

Table 6-1 Site Inspection of Observations – Findings and Deficiencies

Date	Findings / Deficiencies	Follow-Up Status
5 December 2013	Stagnant water cumulated at the handle of the concrete block, the contractor was reminded to clean to prevent mosquito breeding.	Rectified on 12 Dec 2013.
12 December 2013	The rock bund in the de-silting channel was broken; the Contractor was reminded to repair it regularly to ensure the de-silting channel functional properly.	Rectified on 17 Dec 2013.
17 December 2013	• Sand and mud was observed at the public road near the works area, the contractor was reminded to clean and maintain the public road near the site area keep clean.	Rectified on 27 Dec 2013.
27 December 2013	No adverse environmental issue was observed during site inspection.	N.A.

LANDSCAPE AND VISUAL INSPECTION

- 6.03 In this Reporting Period, landscape and visual inspection was carried on 11 and 27 December 2013.
- 6.04 The stand-alone of monthly Landscape & Visual Report signed by the registered Landscape Architect. Mitigation measures implemented in this Reporting Period are presented in the monthly Landscape & Visual Report (December 2013) which enclosed in *Appendix L*.
- 6.05 The next bi-weekly Landscape & Visual Monitoring in **January 2014** is scheduled to be conducted in the week of **6 and 20 January 2014**.



7.0 ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE

ENVIRONMENTAL COMPLAINT, SUMMONS AND PROSECUTION

7.01 No environmental complaint, summons and prosecution was received in this Reporting Period. The statistical summary table of environmental complaint is presented in *Tables 7-1*, 7-2 and 7-3.

Table 7-1 Statistical Summary of Environmental Complaints

Domonting Dowled	Envir	onmental Complaint S	tatistics
Reporting Period	Frequency	Cumulative	Complaint Nature
July 2011 –November 2013	0	0	NA
December 2013	0	0	NA

Table 7-2 Statistical Summary of Environmental Summons

Domontino Dominal	Envir	ronmental Summons St	atistics
Reporting Period	Frequency	Cumulative	Complaint Nature
July 2011 –November 2013	0	0	NA
December 2013	0	0	NA

Table 7-3 Statistical Summary of Environmental Prosecution

Departing Davied	Enviro	onmental Prosecution S	Statistics
Reporting Period	Frequency	Cumulative	Complaint Nature
July 2011 –November 2013	0	0	NA
December 2013	0	0	NA



8.0 IMPLEMENTATION STATUS OF MITIGATION MEASURES

8.01 The environmental mitigation measures that recommended in the Updated Environmental Monitoring and Audit Manual covered the issues of dust, noise and waste and they are summarized as follows:

Noise Mitigation Measure

- (a) Only well-maintained plant should be operated on-site and plant shall be serviced regularly during the construction program;
- (b) Silencers or mufflers on construction equipment should be utilized and shall be properly maintained during the construction program;
- (c) Mobile plant, if any, should be sited as far from NSRs as possible;
- (d) Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;
- (e) Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs;
- (f) Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities;
- (g) Use of quieter plants to carry out the construction tasks proposed for the Project;
- (h) Use about 3.5m high of temporary noise barriers as screened the noisy PMEs to carry out construction of box culvert and site clearance.
- (i) Low Impact Method, such as using PMEs smaller in size and to be enclosed by noise enclosure, should be adopted for the construction of box culvert and pipe laying in Wai Ha; and
- (j) Use of noise enclosure during the works area for pipe laying in Wai Ha.

Dust Mitigation Measure

- 8.02 Implementation of mitigation measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices including but not limited to the following:
 - (a) Use of regular watering to reduce dust emissions from exposed site surfaces and unpaved road, with complete coverage, particularly during dry weather;
 - (b) Use of frequent watering for particularly dusty static construction areas and areas close to ASRs;
 - (c) Tarpaulin covering of all dusty vehicle loads transported to, from and between site location;
 - (d) Establishment and use of vehicle wheel and body washing facilities at the exit points of the site;
 - (e) Routing of vehicles and positioning of construction plant should be at the maximum possible distance from ASRs;
 - (f) Stockpiled excavated materials should be covered with tarpaulin and should be removed offsite within 24 hours to avoid any odour nuisance arising.

Local Stream Water Quality Mitigation Measure

- (a) Before commencing any site formation work, all sewer and drainage connections shall be sealed to prevent debris, soil, sand etc. from entering public sewers/drains;
- (b) Temporary ditches shall be provided to facilitate run-off discharge into appropriate watercourses, via a silt retention pond. No site run-off shall enter the fishponds at Shuen Wan;
- (c) Sand/silt removal facilities such as sand traps, silt traps and sediment basins shall be provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the Water Pollution Control Ordinance. The design of silt removal facilities shall be based on the guidelines provided in ProPECC PN 1/94. All drainage facilities and erosion and sediment control structures shall be inspected monthly and maintained to ensure proper and efficient operation al all times and particularly during rainstorms
- (d) Water pumped out from excavated pits shall be discharged into sill removal facilities;

DSD Contract No. Contract No. DC/2010/02 - Drainage Improvement in Shuen Wan and Shek Wu Wai





- (e) During rainstorms, exposed slope/soil surfaces shall be covered by a tarpaulin or other means. Other measures that need to be implemented before, during, and after rainstorms as summarized in ProPECC PN 1/94 shall be followed
- (f) Exposed soil areas shall be minimized to reduce potential for increased siltation and contamination of runoff
- (g) Earthwork final surfaces shall be well compacted and subsequent permanent work or surface protection shall be immediately performed to reduce the potential of soil erosion;
- (h) Open stockpiles of construction materials or construction wastes on-site shall be covered with tarpaulin or similar fabric during rainstorms;
- (i) For the construction of the box culvert next to the existing channel of the Wai Ha River, sand bags should be deployed around the boundary of the works trench to prevent muddy water ingress into the adjacent CA or Wai Ha River. Sand bags should also be used to surround the excavated trench. Generally, the sand bags will be placed up to a height 01 300mm to provide adequate allowance for the built-up water level during rainstorm event. With sand bags in place surface runoff will be intercepted and flow to Wai Ha River or collected by the existing drainage system as usual;
- (j) For the construction of the box culvert in the extreme northeast corner of Shuen Wan Marsh Conservation Area sand bags should be deployed along the limit of the works area to prevent muddy water ingress into the CA. Sand bags should be placed to a height 0.1 at least 300mm from ground level and +2.5 mPD (whichever is greater) to provide adequate allowance for the built-up water level during rainstorm events Unpolluted surface runoff within the works area should then be collected and directed into the existing drainage system;
- (k) Sheet-piles, which would be installed around the works trench near the Conservation Area, would be extended above ground level for about 2m to serve as hoardings to isolate the works site:
- (l) Tarpaulin sheets would be used to cover the excavation areas during heavy rainstorms. This would prevent the ingress of rainwater into the trench minimizing the risk of muddy water getting into Wai Ha River and the adjacent Conservation Area;
- (m) Any concrete washing water would be contained inside the works site surrounded by the extended sheet piles. A pump sump at the bottom 0f the trench would be provided to pump any excess water during concrete washing;
- (n) Stockpiling the excavated materials adjacent to the Conservation Area would not be allowed. The excavated materials would be either removed off site immediately after excavation, or stockpile at location(s) away from the Conservation Area. The stockpile locations shall be approved by the site engineer;
- (o) Debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering the Wai Ha River and fish ponds at Shuen Wan. Stockpiles of cement and other construction materials should be kept covered when not being used.
- (p) Oils and fuels should only be used and stored in designated areas which have pollution prevention facilities to prevent spillage of fuels and solvents to nearby water bodies, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity 01 the largest tank The bund should be drained of rainwater after a rain event
- (q) Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site. A licensed contractor would be responsible for appropriate disposal and maintenance of these facilities:
- (r) The excavation works within the upstream end of the existing river channel of the Wai Ha River for the construction of the proposed box culvert should be carried out in dry condition. Containment measures such as bunds and barriers shall be used within the affected length of the river channel and the excavation works restricted to within an enclosed dry section of the channel. The excavation works within Wai Ha River shall be restricted to the period from October to April.



Waste Mitigation Measures

- (a) The Contractor shall observe and comply with the Waste Disposal Ordinance (WDO) and its subsidiary regulations.
- (b) The Contractor shall submit to the Engineer for approval a Waste Management Plan with appropriate mitigation measures including the allocation of an area for waste segregation and shall ensure that the day-to-day site operations comply with the approved waste management plan.
- (c) The Contractor shall minimize the generation of waste from his work. Avoidance and minimization of waste generation can be achieved through changing or improving design and practices, careful planning and good site management.
- (d) The reuse and recycling of waste shall be practised as far as possible. The recycling materials shall include paper/cardboard, timber and metal etc.
- (e) The Contractor shall ensure that Construction and Demolition (C&D) materials are sorted into public fill (inert portion) and C&D waste (non-inert portion). The public fill which comprises soil, rock, concrete, brick, cement plaster/mortar, inert building debris, aggregates and asphalt shall be reused in earth filling, reclamation or site formation works. The C&D waste which comprises metal, timber, paper, glass, junk and general garbage shall be reused or recycled where possible and, as the last resort, disposal of at landfills.
- (f) The Contractor shall record the amount of wastes generated, recycled and disposed of (including the disposal sites). The Contractor shall use a trip ticket system for the disposal of C&D materials to any designated public filling facility and/or landfill.
- (g) In order to avoid dust or odour impacts, any vehicles leaving a works area carrying construction waste or public fill shall have their load covered.
- (h) To avoid the excessive use of wood, reusable steel shutters shall be used as a preferred alternative to formwork and falsework where possible.
- (i) The Contractor shall observe and comply with the Waste Disposal (Chemical Waste) (General) Regulation. The Contractor shall apply for registration as chemical waste producer under the Waste Disposal (Chemical Waste) (General) Regulation when chemical waste is produced. All chemical waste shall be properly stored, labeled, packaged and collected in accordance with the Regulation.
- 8.03 KLKJV had been implementing the required environmental mitigation measures according to the Updated Environmental Monitoring and Audit Manual subject to the site condition. Environmental mitigation measures generally implemented by KLKJV in this Reporting Period are summarized in *Table 8-1*.

Table 8-1 Environmental Mitigation Measures

Issues	Environmental Mitigation Measures
Water Quality	 Wastewater were appropriately treated by treatment facilities; Drainage channels were provided to convey run-off into the treatment facilities; and
	Drainage systems were regularly and adequately maintained.
Air Quality	 Regular watering to reduce dust emissions from all exposed site surface, particularly during dry weather; Frequent watering for particularly dusty construction areas and areas close to air sensitive receivers; Cover all excavated or stockpile of dusty material by impervious sheeting or sprayed with water to maintain the entire surface wet; Public roads around the site entrance/exit had been kept clean and free from dust; and Tarpaulin covering of any dusty materials on a vehicle leaving the site.
Noise	 Good site practices to limit noise emissions at the sources; Use of quite plant and working methods; Use of site hoarding or other mass materials as noise barrier to screen noise at ground level of NSRs; Use of shrouds/temporary noise barriers to screen noise from relatively static PMEs; Scheduling of construction works nearly Tung Tsz Road; and Alternative use of plant items within one worksite, where practicable.

DSD Contract No. Contract No. DC/2010/02 - Drainage Improvement in Shuen Wan and Shek Wu Wai

30th Monthly EM&A Report – December 2013



Issues	Environmental Mitigation Measures
Chemical Management	 Excavated material should be reused on site as far as possible to minimize off-site disposal. Scrap metals or abandoned equipment should be recycled if possible; Waste arising should be kept to a minimum and be handled, transported and disposed of in a suitable manner; The Contractor should adopt a trip ticket system for the disposal of C&D materials to any designed public filling facility and/or landfill; and Chemical waste shall be handled in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Wastes.
General	The site was generally kept tidy and clean.



9.0 IMPACT FORCAST

CONSTRUCTION ACTIVITIES FOR THE FORTH-COMING MONTH

- 9.01 Construction activities planned to be carried out next month at Shuen Wan is listed as below:-
 - Construction of Box Culvert Bay (3-4)
 - Excavation of box culvert at Bay (12-15)
 - Construction of Box at Bay (16-19)
 - Construction of Box Culvert Bay (28-31)
 - Construction of box culvert at Bay (32-34)
 - Construction of box culvert at Bay (Wai Ha Intake and Bay 15)
- 9.02 Three months Rolling Construction Program is attached in *Appendix C*

KEY ISSUES FOR THE COMING MONTH

- 9.03 According to construction activities carry out in coming months, key issues to be considered include:
 - Implementation of dust suppression measures at all times;
 - Ensure dust suppression measures are implemented properly;
 - Disposal of empty engine oil containers within site area;
 - Sediment catch-pits and silt removal facilities should be regularly maintained;
 - Management of chemical wastes;
 - Discharge of site effluent to the nearby local stream or storm drainage, stockpiling or disposal of materials, and any dredging or construction area at this area are prohibited;
 - Follow-up of improvement on general waste management issues; and
 - Implementation of construction noise preventative control measures.



10.0 CONCLUSIONS AND RECOMMENTATIONS

CONCLUSIONS

- 10.01 This is the 30th monthly EM&A report for Contract 2 presenting the monitoring results and inspection findings for the Reporting Period from 1 to 31 December 2013.
- 10.02 No noise complaint (which is an Action Level exceedance) was received and no construction noise measurement results that exceeded the Limit Level were recorded in this Reporting Period. No NOE or the associated corrective actions were therefore issued.
- 10.03 For water quality monitoring, a total of 65 Action/ Limit Level exceedances, namely 29 exceedances in dissolved oxygen, 22 exceedances in turbidity and 14 exceedances in suspended solids were recorded in this Reporting Period. NOEs were issued to notify EPD, IEC, the Contractor and RE upon confirmation of the results. It is concluded that exceedances on 16 December 2013 were partially due to Project. The Contractor should enhance the water quality mitigation measures such as covering all exposed slopes to prevent surface runoff and improve the desilting facilities as far as practicable.
- 10.04 The hydrological characteristics of water depth and water flow rate were found no exceedance in this Reporting Period.
- 10.05 In this Reporting Period, no ecological monitoring in Area under Contract 2 was performed.
- 10.06 No documented complaint, notification of summons or successful prosecution was received.
- 10.07 Weekly environmental site inspections had been carried out by the Contractor, ET and the RE on 5,
 12, 17 and 27 December 201. Furthermore, joint site inspection with the IEC was carried out on
 17 December 2013. In this Reporting Period, 3 observations were recorded but no non-compliance was noted during the site inspection.
- 10.08 In this Reporting Period, landscape and visual inspection was carried on 11 and 27 December 2013 and the monthly Landscape & Visual Report (December 2013) has been signed by the registered Landscape Architect.


RECOMMENDATIONS

- 10.09 As river works is in progress, surface runoff or water discharge to local stream course should be key environment aspect issue. The Contractor is reminded that mitigation measures for water quality and ecology should be fully implemented. As an effective water quality mitigation measure, the rock bund in the de-silting channel should be repaired regularly and ensure the de-silting performance.
- 10.10 During dry season, dust mitigation measures to avoid fugitive dust emissions from loose soil surface or haul road would be a key issue in coming months.
- 10.11 Special attention should be also paid on the muddy water and other water quality pollutants via site surface water runoff into the local stream Wah Ha River. As an effective water quality mitigation measure, the rock bund in the de-silting channel should be repaired regularly and ensure the de-silting performance.
- 10.12 To control the site performance on waste management, the KLKJV shall ensure that all solid and liquid waste management works are fully in compliance with the relevant license/permit requirements, such as the effluent discharge licence and the chemical waste producer registration. KLKJV is also reminded to implement the recommended environmental mitigation measures according to the Updated Environmental Monitoring and Audit Manual.



Appendix A

Site Location Plan (DSD Contract 1 and Contract 2 at Shuen Wan)

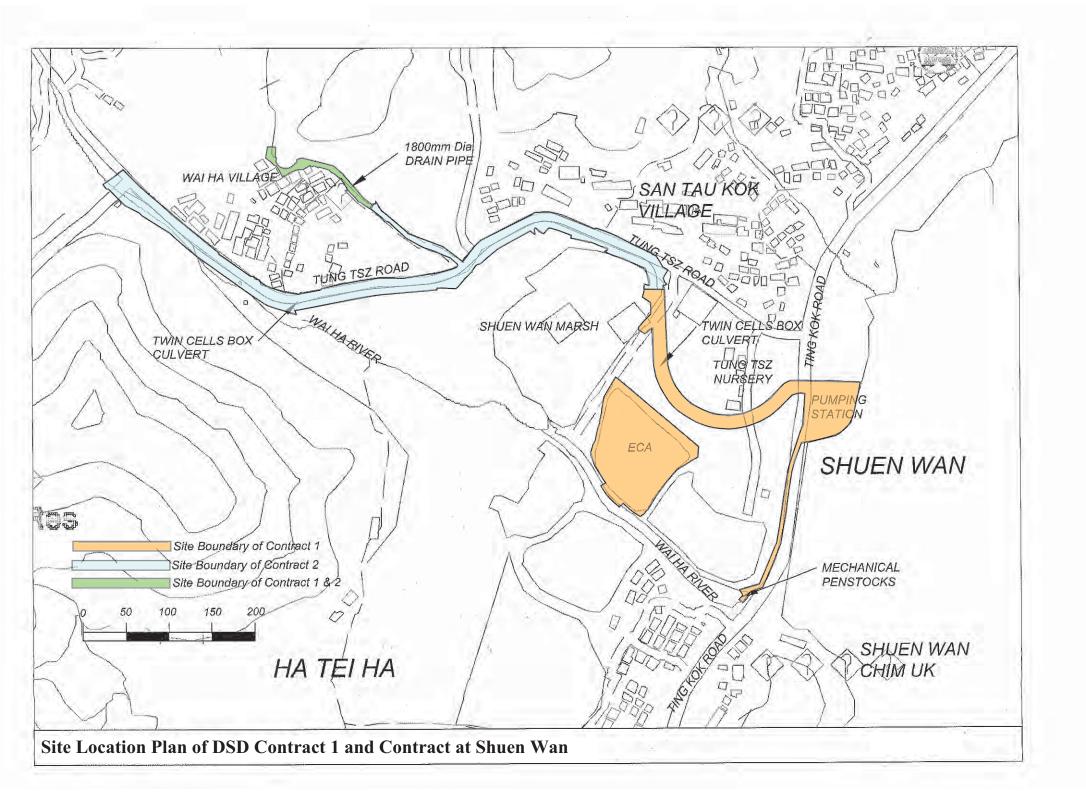




Appendix B

Organization Chart and the Key Contact Person



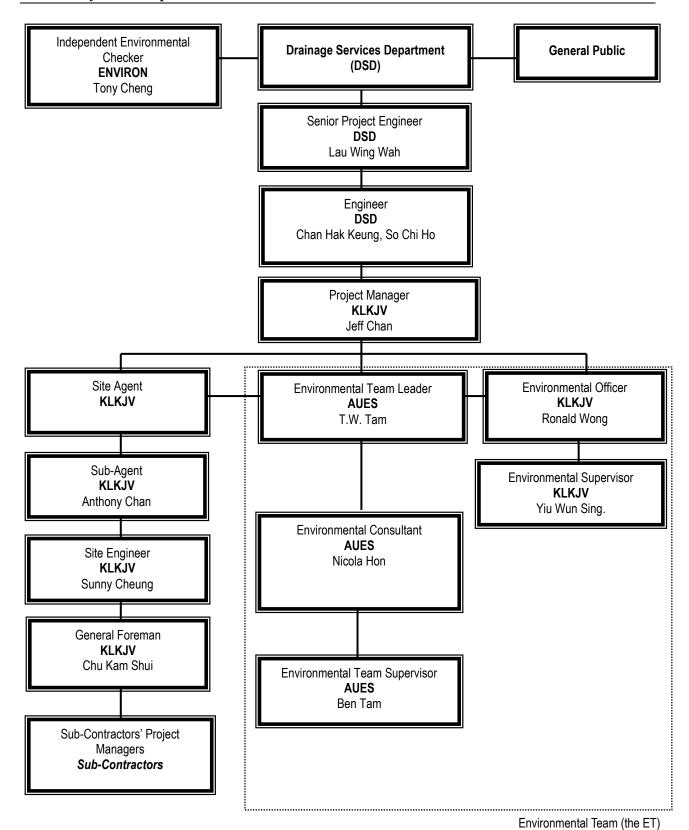

Environmental Management Organization



Contact Details of Key Personnel

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
DSD	Employer	Mr. Luk Wai Hung	2594 7400	2827 8700
DSD	Senior Engineer	Mr. Lau Wing Wah	2594 7402	2827 8700
DSD	Engineer	Mr. Chan Hak Keung	2594 7596	2827 8700
DSD	Engineer	Mr. So Chi Ho	2594 7356	2827 8700
DSD	Senior Inspector	Mr. Tso Si On	6778 2708	2827 8700
ENVIRON	Independent Environmental Checker	Mr. Tong Cheng	3465-2888	3465-2899
KLKJV	Project Director	Mr. Poon Chi Yeung Francis	2674 3888	2674 9988
KLKJV	Project Manager	Mr. Jeff Chan	2674 3888	2674 9988
KLKJV	Sub- Agent	Mr. Anthony Chan	2674 3888	2674 9988
KLKJV	Site Forman	Mr. Chu Kam Shui	2674 3888	2674 9988
KLKJV	Environmental Officer	Mr. Ronald Wong	2674 3888	2674 9988
KLKJV	Environmental Supervisor	Mr. Yiu Wun Sing	2674 3888	2674 9988
AUES	Environmental Team Leader	Mr. T.W. Tam	2959-6059	2959-6079
AUES	Environmental Consultant	Miss. Nicola Hon	2959-6059	2959-6079
AUES	Environmental Supervisor	Mr. Ben Tam	2959-6059	2959-6079

Legends:

DSD (Employer) – Drainage Services Department

DSD (Engineer) – Drainage Services Department

KLKJV (Main Contractor) – Kwan Lee-Kuly Joint Venture


ENVIRON (IEC) - ENVIRON Hong Kong Limited

AUES (ET) – Action-United Environmental Services & Consulting





Appendix C

Master Construction Programs

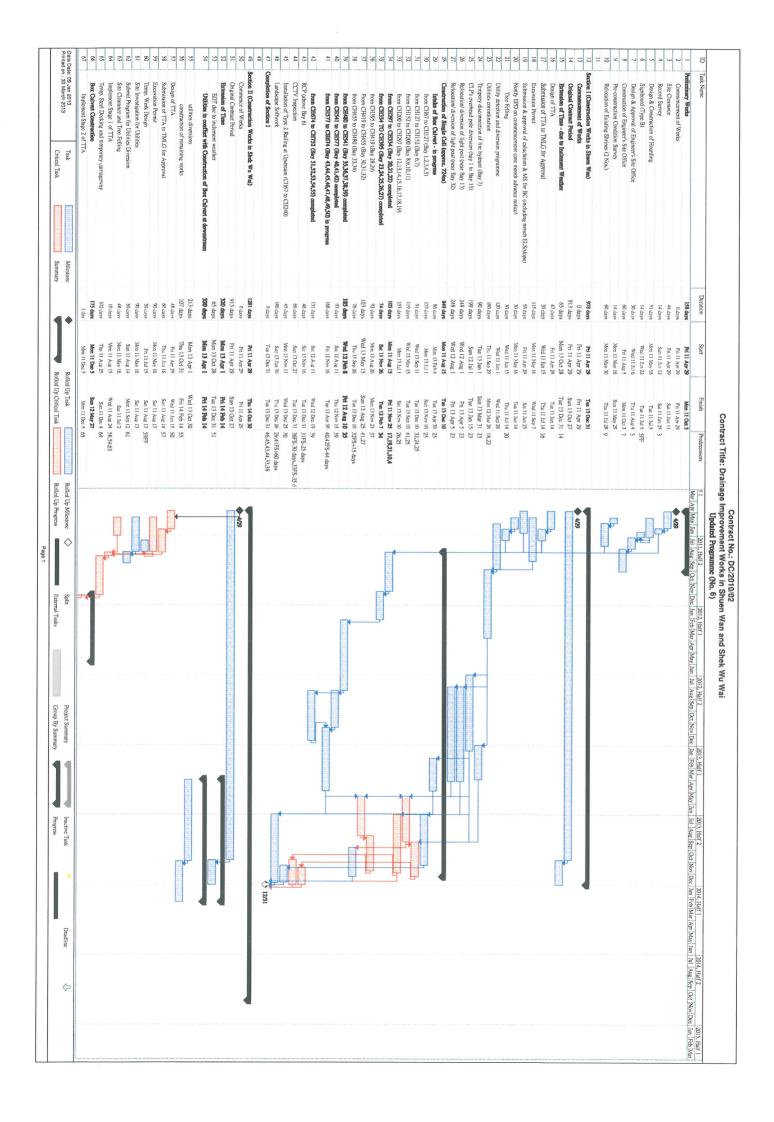

			•		
	Sep 15	Sun 12 Apr 29 Sun 13 Sep 15		505 days	Retaining Wall RW & Access Ramp
	Fri 14 Feb 14 128FS-7 days,136		_		Implementation of TTA, Permanent road surface & Paving block for footpath and associated works
	Wed 13 Dec 4 127,108,93,98,103				Construction of remaining top state of box curvert and rootpain at downstream
	Feb 14 126			l day	Resume Castle Peak Road traffic for both direction
	Feb 13 125	Tau 13 Jan 24 Wed 13 Feb 13		21 days	Temporary road surface for West Bound
	Tue 13 Jan 22 123			14 days	Temporary road surface for East Bound
	Tue 13 Jan 8 121			14 days	Backfilling and removal of temporary works
	Tue 13 Jan 8 121			14 days	Construction of temp, footway at downstream
	Reb 14 Dec 25 118	Wed 12 Dec 5 Tue 12 Dec 25		437 days	Construction of top slab of hox culvert for East Bound
	Thu 13 Jan 17 117			48 days	WSD - diversion of 3 nos, dia.25 pipes
	Tue 12 Dec 4 117			4 days	WSD - removal of disused pipes/ reinstatement
₽4	Fri 12 Nov 30 116,115			3 days	WSD - shutdown & commissioning by WSD
	Nov 27 114			6 days	WSD - swabling/ flushing/ sterilization
	Nov 22 114	Thu 12 Nov 22 Thu 12 Nov 22		l day	WSD - inspection of connection points with WSD
	Sit 12 New 21 112 112			7 days	WSD - pipes transcation installation & laying (near KW2)
H-	New 14 83FS-5 days,111	4		12 days	WSD - pipes frabrication, installation & laying (near RW1)
	Aug 4			75 days	WSD - material delivery
	Jan 17	May 22 Thu 13 Jan 17	lys Tue 12 May 22	241 days	WSD
					hanged up for construction of remaining Box Culvert
	Oct 30 106	Wed 13 May 1 Wed 13 Oct 30 Wed 13 May 1 The 14 Oct 30		183 days	PCCW - diversion & changing over (local cables) PCCW - diversion & changing over (overwas cables - about 4 nos) - to be
	Sun 13 Mar 17 87,105,119				PCCW - manholes & ducting construction works (near RW2)
	Apr 30 83,107			44 days	PCCW - manholes & ducting construction works (near RW1)
	Thu 12 Jul 12		iys Mon 12 May 14	60 days	PCCW - XP application
	Oct 30	May 14 Thu 14 Oct 30	lys Mon 12 May 14	900 days	PCCW
	Aug 19 101			90 days	HGC - diversion & changing over
	Mar 31 100,107			14 days	HGC - manholes & ducting construction works (near RW2)
	May 21 102.106	_		21 days	HGC - manholes & ducting construction works (near RW1)
	Thu 12 Jul 12	,		60 days	HGC - XP application
	on 13 Aug 19		-	463	HGC
	Mon 13 Sep 9 06	Wed 13 Jun 12 Mon 13		90 days	NWT - diversion & changing construction works (near No.2)
	Sun 13 Apr 14 US 102			21 days	NWT - menholes & ducting construction works (near RW1)
	Tau 12 Jul 12			60.	NWT - XP application
	Sep 9	_		484 days	NWT
	Sun 13 Jun 16 91			21 1	CLP (2 no. 11kV cables) - changing over
	Sun 13 May 5 90,97			21 days	CLP (2 no. 11kV cables) - ducting & cable works (near RW2)
	Tau 12 Jul 12	Mon 13 May 6 Sun 13 May 76		60 days	CLP (2 no. 11kV cables) - XP application
	Jm 16	"		399 days	CLP (2no. 11kV cables)
	Oct 30		lys Mon 12 May 14	900 days	Utilities Diversion by UU
	Sep 17 86			60 days	Retaining wall RW2 (wing wall)
	Thu 12 Jul 19 85	Fr. 12 Jul 13 Thu 12		7 days	PCCW - demolition of existing joint box/ cable drawnit
	Separ	9		127 days	Construction of Rw2 (wing with)
	2Nov 7 82			68 days	Retaining wall RWI - wing wall portion
	Fri 12 Aug 31 81	Sat 12 Aug 25 Fri 12		7 days	CLP (overhead pole) - removal of overhead pole
	Aug 24 80	Sat 12 Aug 11 Fri 12.		14 days	CLP (overhead pole) - changing over
•	Fri 12 Aug 10 78			75 days	CLP (everhead pole) - cable laying
	Nov 7	May 28 Wed 12 Nov 7	avs Mon 12 May 28	164 days	Bound) Construction of RW1 wine wall portion
	May 27 77				Construction of 3.5m wide top slab of box culvert along Castle Peak Road (Fast
-	Apr 16 76	Sut 12 Apr 14 Mon 12 Apr 16		3 days	Remove Temporary flow diversion
	Fri 12 Apr 13 75				Construction of Base Slab & Wall of Box Culvert along Castle Peak Road (East
-	Wed 12 Mar 14 74	Mon 12 Mar 12 Wed 12		Last State	Demolish Exisiting Box Culvert (East Bound)
	Sun 12 Mar 11 73			7.	Temporary support for utilities
	Nur 4 77 71	Tue 12 Feb 28 Sm 12	6 days Tige 1	o ~	Installation of steel sheet miles
	Feb 27 70			. 7	Trial pit for utilities
P	Feb 20 69				Implement Stage 3 of TTA
	Sun 12 Feb 19 68		_	33 Gavs	demolition of ex. BC Temporary carriageway for stage 3 TTA
Mari Are May Jan Jibi Jang Sep JOu New Dec Jan Jeel Mari Are May Jan Jibi Jang Sep JOu New Dec Jan Jeel Mari Are May Jan Jibi Jang Sep Jou New Dec Jan Jeel Mari Are May Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jan Jibi Jan Jibi Jang Sep Jou New Dec Jan Jeel Mary Jan Jibi Jan	Tue 12 Jan 17 67 Mar Apr May Jun	Tuz 11 Doc 6 Tue 12		43 days	Construction of Box Culvert along Castle Peak Road (West Bound) including
Prodocessors (f.1 2011, Half 2 2012, Half 1 2012, Half 2 201	Prodecessors [f]	Finish	Start	Duration	AST INAMES

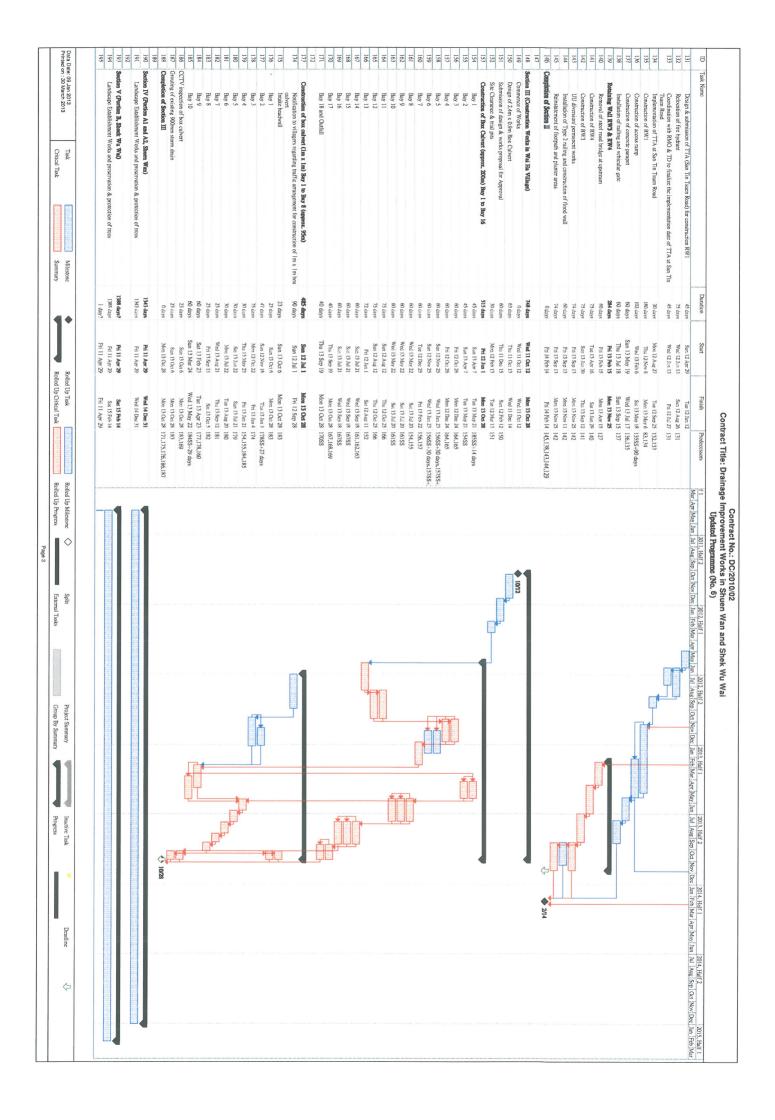


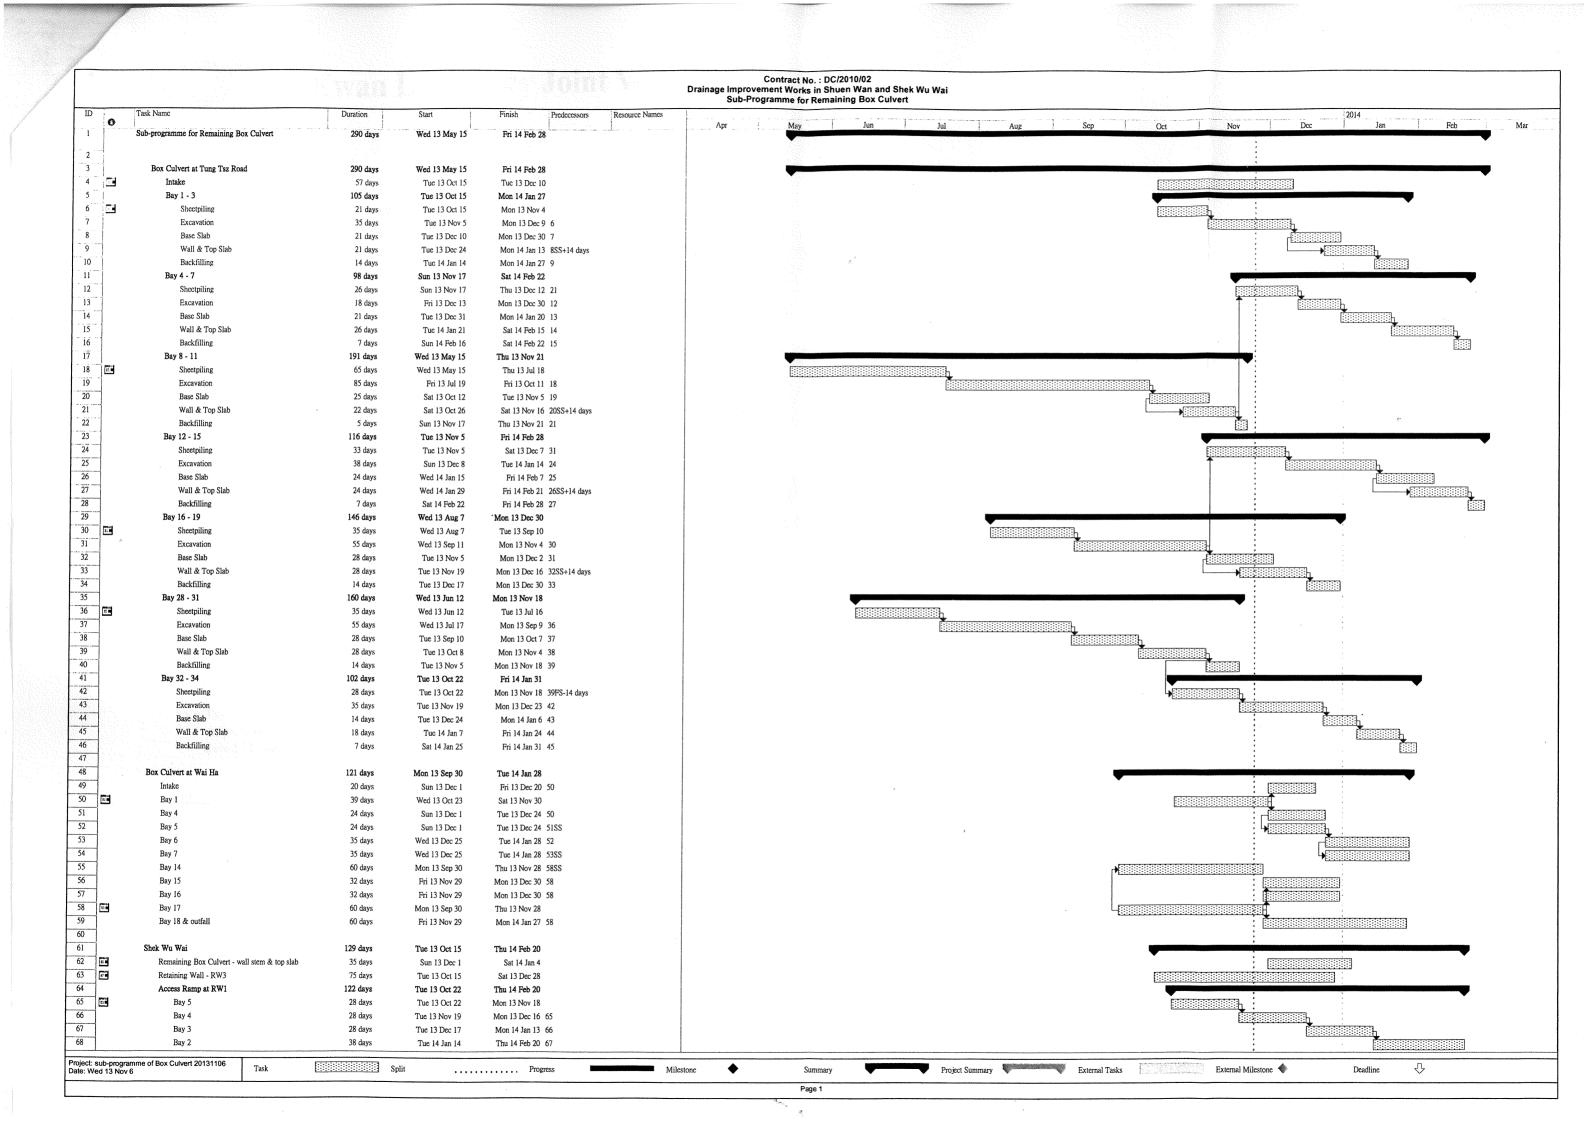



Appendix D

Environmental Monitoring Locations

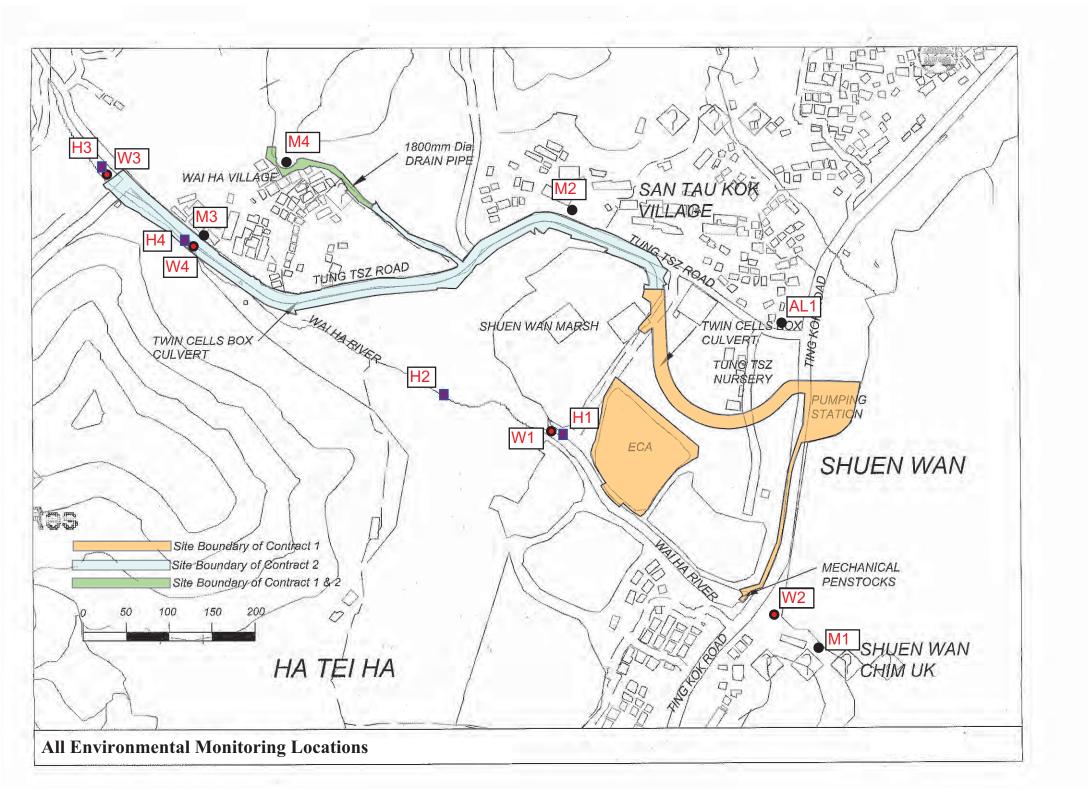



Appendix E

Calibration certificates of the monitoring equipment and Certificate of ALS Technichem (HK) Pty Ltd



Equipment Calibration List

Items	Aspect	Description of Equipment	Date of Calibration	Date of Next Calibration
1	NJ-1	Bruel & Kjaer Integrating Sound Level Meter (Serial No. 2285762)	27 April 13	27 April 14
2	Noise	Bruel & Kjaer Acoustical Calibrator (Serial No. 2326408)	15 April 13	15 April 14
3	Water	SONDA YSI 6820 (Serial No. 02J0912)	15 Oct 13	15 Jan 14

Note: *Calibration certificates will only be provided when monitoring equipment is re-calibrated or new.



Appendix F

Event and Action Plan

DSD Contract No. Contract No. DC/2010/02 - Drainage Improvement in Shuen Wan and Shek Wu Wai

30th Monthly EM&A Report – December 2013



Event Action Plan for Construction Noise

EVENT				
EVENI	ET Leader	IEC	ER	Contractor
Action Level	Notify IEC and Contractor Carry out investigation. Report the results of investigation to the IEC, ER and Contractor. Discuss with the Contractor and formulate remedial measures Increase monitoring frequency to check mitigation effectiveness.	Review the analyzed results submitted by the ET. Review the proposed remedial measures by the Contractor and advise the ER accordingly Supervise the implementation of remedial measures	Confirm receipt of notification of failure in writing Notify Contractor Require Contractor to propose 'remedial measures for the analyzed noise problem Check remedial measures are properly implemented.	Submit noise mitigation proposals to IEC Implement noise mitigation proposals
Limit Level	Notify IEC, ER, EPD and Contractor Identify source. Repeat measurements to confirm findings Increase monitoring frequency. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented Inform IEC, ER and EPD the causes and actions taken for the exceedances Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results If exceedance stops, cease additional monitoring.	Discuss amongst ER, ET, and Contractor on the potential remedial actions Review Contractor's' remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly Supervise the implementation of remedial measures	1. Confirm receipt of notification of failure in writing 2. Notify Contractor 3. Require Contractor to propose remedial measures for the analyzed noise problem 4. Check remedial measures properly implemented. 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated	 Take immediate action to avoid further exceedance Submit proposals for remedial actions to IEC within 3 working days of notification Implement the agreed proposals Resubmit proposals if problem still not under control Stop the relevant portion of works as determined by the ER until the exceedance is abated



Event and action Plan for Water Quality

Event	ET Leader	IEC ACTION LEVEL	ER	Contractor
Action level being exceeded by one sampling day	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform IEC, Contractor and Engineer; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented. 7. Repeat measurement on next day of exceedance.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IEC, ET and Contractor; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	Inform Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes in working methods; Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; Implement agreed mitigation measures.
Action level being exceeded by more than two consecutive sampling days	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform IEC, Contractor and Engineer; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented. 7. Prepare to increase the monitoring frequency to daily; 8. Repeat measurement on next day of exeedance.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IEC, ET and Contractor; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	Inform Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes in working methods; Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; Implement agreed mitigation measures
Limit level being exceeded by one sampling day	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform EPD, IEC, Contractor and Engineer; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit Level.	1. Discuss mitigation measures with ET, Engineer and Contractor; 2. Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; 3. Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IEC, ET and Contractor; Request Contractor to critically review the working methods; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	Inform Engineer and confirm in writing notification of the non-compliance; Rectify unacceptable practice; Check all plant and equipment; Consider changes in working methods; Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; Implement agreed mitigation measures.
Limit level being exceeded by more than two consecutive sampling days	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform EPD, IEC, Contractor and Engineer; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented. 7. Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	1. Discuss proposed mitigation measures with IEC, ET and Contractor; 2. Request Contractor to critically review the working methods; 3. Make agreement on mitigation measures to be implemented; 4. Assess effectiveness of implemented mitigation measures; 5. Consider and if necessary instruct Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit Level.	1. Inform Engineer and confirm in writing notification of the non-compliance; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes in working methods; 5. Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; 6. Implement agreed mitigation measures; 7. As directed by the Engineer, slow down or stop all or part of the construction activities until no exceedance of Limit level.



Event and action Plan for Hydrological Characteristics

Event ACTION LEVEL	ET Leader	IEC	ER	Contractor
Action level being exceeded by one sampling day	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform IEC, Contractor and Engineer; 4. Check monitoring data, Contractor's working methods and any excavation works or dewatering processes; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented. 7. Repeat measurement on next day of exceedance.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IEC, ET and Contractor; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	1. Inform Engineer and confirm in writing notification of the non-compliance; 2. Rectify unacceptable practice; 3. Check working methods and any excavation works or dewatering processes; 4. Consider changes in working methods and plans; 5. Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; 6. Implement agreed mitigation measures.
Action level being exceeded by more than two consecutive sampling days	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform IEC, Contractor and Engineer; 4. Check monitoring data, Contractor's working methods and any excavation works or dewatering processes; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented. 7. Prepare to increase the monitoring frequency to daily; 8. Repeat measurement on next day of exceedance.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IEC, ET and Contractor; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	1. Inform Engineer and confirm in writing notification of the non-compliance; 2. Rectify unacceptable practice; 3. Check working methods and any excavation works or dewatering processes; 4. Consider changes in working methods and plans; 5. Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; 6. Implement agreed mitigation measures
LIMIT LEVEL Limit level being exceeded by one sampling day	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform AFCD, IEC, Contractor and Engineer; 4. Check monitoring data, and Contractor's working methods and any excavation works or dewatering processes; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit level.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	Discuss proposed mitigation measures with IEC, ET and Contractor; Request Contractor to critically review the working methods; Make agreement on mitigation measures to be implemented; Assess effectiveness of implemented mitigation measures.	1. Inform Engineer and confirm in writing notification of the non-compliance; 2. Rectify unacceptable practice; 3. Check working methods and any excavation works or dewatering processes; 4. Consider changes in working methods and plans; 5. Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; 6. Implement agreed mitigation measures.
Limit level being exceeded by more than two consecutive sampling days	1. Repeat in-situ measurements to confirm findings; 2. Identify reasons for non-compliance and source(s) of impact; 3. Inform AFCD, IEC, Contractor and Engineer; 4. Check monitoring data and Contractor's working methods and any excavation works or dewatering processes; 5. Discuss mitigation measures with IEC, Engineer and Contractor; 6. Ensure mitigation measures are implemented. 7. Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days.	Discuss mitigation measures with ET, Engineer and Contractor; Review proposals on mitigation measures submitted by Contractor and advise the Engineer accordingly; Assess effectiveness of implemented mitigation measures.	1. Discuss proposed mitigation measures with IEC, ET and Contractor; 2. Request Contractor to critically review the working methods; 3. Make agreement on mitigation measures to be implemented; 4. Assess effectiveness of implemented mitigation measures; 5. Consider and if necessary instruct Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit Level.	1. Inform Engineer and confirm in writing notification of the non-compliance; 2. Rectify unacceptable practice; 3. Check working methods and any excavation works or dewatering processes; 4. Consider changes in working methods and plans; 5. Discuss with ET, IEC and Engineer and propose mitigation measures to IEC and Engineer within three working days; 6. Implement agreed mitigation measures; 7. As directed by the Engineer, slow down or stop all or part of the construction activities until no exceedance of Limit level.



Appendix G

Monitoring Schedule in Reporting Period and the Coming Month





Monitoring Schedule in this Reporting Period – December 2013

		Stream M	N. M. W.	
L	Date	Water Sampling	Flow Monitoring	Noise Monitoring
Sun	1-Dec-13			
Mon	2-Dec-13	W1, W2, W3, W4		
Tue	3-Dec-13			
Wed	4-Dec-13	W1, W2, W3, W4		
Thu	5-Dec-13			
Fri	6-Dec-13	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Sat	7-Dec-13			
Sun	8-Dec-13			
Mon	9-Dec-13	W1, W2, W3, W4		
Tue	10-Dec-13			
Wed	11-Dec-13	W1, W2, W3, W4		
Thu	12-Dec-13			
Fri	13-Dec-13	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Sat	14-Dec-13			
Sun	15-Dec-13			
Mon	16-Dec-13	W1, W2, W3, W4		
Tue	17-Dec-13			
Wed	18-Dec-13	W1, W2, W3, W4		
Thu	19-Dec-13			
Fri	20-Dec-13	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Sat	21-Dec-13			
Sun	22-Dec-13			
Mon	23-Dec-13	W1, W2, W3, W4		
Tue	24-Dec-13			
Wed	25-Dec-13			
Thu	26-Dec-13			
Fri	27-Dec-13	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Sat	28-Dec-13			
Sun	29-Dec-13			
Mon	30-Dec-13	W1, W2, W3, W4		
Tue	31-Dec-13			

Monitoring Day
Sunday or Public Holiday





Monitoring Schedule for next Reporting Period – January 2014

	Date	Stream M	Noise Monitoring	
L	vate 	Water Sampling	Flow Monitoring	Noise Monitoring
Wed	1-Jan-14			
Thu	2-Jan-14	W2		
Fri	3-Jan-14	W1, W3, W4	H3, H4	M1, AL1,M2, M3, M4
Sat	4-Jan-14	W2	H1, H2	
Sun	5-Jan-14			
Mon	6-Jan-14	W1, W2, W3, W4		
Tue	7-Jan-14			
Wed	8-Jan-14	W1, W2, W3, W4		
Thu	9-Jan-14			
Fri	10-Jan-14	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Sat	11-Jan-14			
Sun	12-Jan-14			
Mon	13-Jan-14	W1, W2, W3, W4		M1, AL1,M2, M3, M4
Tue	14-Jan-14			
Wed	15-Jan-14	W1, W2, W3, W4		
Thu	16-Jan-14			
Fri	17-Jan-14	W1, W2, W3, W4	H1, H2, H3, H4	
Sat	18-Jan-14			
Sun	19-Jan-14			
Mon	20-Jan-14	W1, W2, W3, W4		
Tue	21-Jan-14			
Wed	22-Jan-14	W1, W2, W3, W4		
Thu	23-Jan-14			
Fri	24-Jan-14	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Sat	25-Jan-14			
Sun	26-Jan-14			
Mon	27-Jan-14	W1, W2, W3, W4		
Tue	28-Jan-14			
Wed	29-Jan-14	W1, W2, W3, W4	H1, H2, H3, H4	M1, AL1,M2, M3, M4
Thu	30-Jan-14			
Fri	31-Jan-14			

Monitoring Day
Sunday or Public Holiday



Appendix H

Meteorological Data of Reporting Period



Meteorological Data in Reporting Period

				Tai Po	Station	Shatin Station		
Date		Weather	Total Rainfall (mm)	Mean Air Temp. (°C)	Mean Relative Humidity (%)	Wind Speed (km/h)	Wind Direction	
1-Dec-13	Sun	Fine and very dry. Moderate north to northeasterly winds.	0	15.8	50.5	6	N/NE	
2-Dec-13	Mon	Fine and dry. Moderate east to northeasterly winds.	0	16.2	48	6.1	N/NE	
3-Dec-13	Tue	Fine and dry. Moderate east to northeasterly winds.	0	17.8	57.5	5.9	N/NE	
4-Dec-13	Wed	Fine and dry. Moderate northeasterly winds.	0	17.9	52	9.6	NE	
5-Dec-13	Thu	Fine and dry. Moderate northeasterly winds.	0	16.5	48	6.5	N/NE	
6-Dec-13	Fri	Fine and dry apart from some haze. Moderate northeasterly winds.	0	16.3	47.5	8.2	NE	
7-Dec-13	Sat	Fine and dry. Moderate northeasterly winds.	0	17.3	57.5	5.3	N/NE	
8-Dec-13	Sun	Fine and dry. Moderate northeasterly winds.	Trace	18.3	73.5	5.5	E/NE	
9-Dec-13	Mon	Cloudy, haze, very dry. Moderate north to northeasterly winds.	0	22.3	56.5	7.2	NE	
10-Dec-13	Tue	Cloudy, haze, dry, sunny periods. Moderate north to northeasterly winds.	0	18.9	57.5	7.2	N/NE	
11-Dec-13	Wed	Cloudy, dry, haze. Moderate east to northeasterly winds, fresh offshore.	0	17.8	64.2	9.2	N/NE	
12-Dec-13	Thu	Cloudy, dry, haze. Moderate east to northeasterly winds, fresh offshore.	Trace	17	59.7	8.2	N/NE	
13-Dec-13	Fri	Cloudy, dry, haze. Moderate east to northeasterly winds, fresh offshore.	Trace	17.2	75.5	5.2	N	
14-Dec-13	Sat	Cloudy, dry, haze. Moderate east to northeasterly winds, fresh offshore.	13	17.9	84.7	6.8	N	
15-Dec-13	Sun	Cloudy, rain. Fresh northerly winds, occasionally strong offshore and on high ground.	22.7	15.9	95.7	8.2	N	
16-Dec-13	Mon	Cloudy, rain. Fresh northerly winds, occasionally strong offshore and on high ground.	24.8	13.2	92.7	9.5	N/NW	
17-Dec-13	Tue	Cloudy, rain. Fresh northerly winds, occasionally strong offshore and on high ground.	27.8	11	94.7	6.6	N/NE	
18-Dec-13	Wed	Fine, dry, cold. Moderate to fresh northerly winds.	0	10.4	68	13.5	N/NE	
19-Dec-13	Thu	Cloudy, dry, fine.Moderate north to northeasterly winds.	0	11.4	57.2	8.7	N/NW	
20-Dec-13	Fri	Cloudy, dry, fine.Moderate north to northeasterly winds.	0	12.3	63	6.6	N/NE	
21-Dec-13	Sat	Fine, dry, cold. Moderate northeasterly winds.	0	13.2	57.2	7.1	N	
22-Dec-13	Sun	Fine, dry, cold. Moderate northeasterly winds.	0	12.5	55	7	NE	
23-Dec-13	Mon	Fine, dry, cold. Moderate northeasterly winds.	0	12.9	59.5	5.5	NE	
24-Dec-13	Tue	Fine, dry, cold. Moderate northeasterly winds.	0	13.3	55	6.6	N/NE	
25-Dec-13	Wed	Fine, very dry, haze, cold. Moderate north to northeasterly winds, fresh at times.	0	14.2	54.5	6.7	N/NE	
26-Dec-13	Thu	Fine, very dry, haze, cold. Moderate north to northeasterly winds.	0	13.4	46	10.5	N/NE	
27-Dec-13	Fri	Fine, very dry, haze, cold. Moderate north to northeasterly winds, fresh at times.	0	12	33.2	14	NE	
28-Dec-13	Sat	Fine, dry, cloudy.Light to moderate east to northeasterly winds.	0	10.2	42.5	6	N/NE	
29-Dec-13	Sun	Fine, very dry, haze, cold. Moderate north to northeasterly winds, fresh at times.	0	10	48.5	6.6	N/NE	
30-Dec-13	Mon	Fine, dry, cloudy.Light to moderate east to northeasterly winds.	0	12.1	47	6	NE	
31-Dec-13	Tue	Fine, dry, cloudy.Light to moderate east to northeasterly winds.	0	13.8	42	5	N/NE	

^{*} The record was downloaded from The Hong Kong Observatory Weather Stations



Appendix I

Data Base of Monitoring Results



Construction Noise Measurement Data

Designated Monitoring Station – M1 (14, Shuen Wan Chim Uk)

Date	Start Time	1 st Leq _{5min}	2 nd Leq _{5min}	3 ^{ra} Leq _{5min}	4 th Leq _{5min}	5 th Leq _{5min}	6 th Leq _{5min}	Leq _{30min*}
4-Dec-13	13:45	-	ı	-	ı	-	-	63.6
11-Dec-13	14:55	-	ı	-	ı	-	-	64.5
18-Dec-13	14:25	-	ı	-	ı	-	ı	61.3
27-Dec-13	15:00	-	-	-	-	-	-	63.5
Limit Level					-			>75 dB(A)

^(*)The monitoring is undertaken under façade situation. No façade correction is added according to acoustical principles and EPD guidelines.

Designated Monitoring Station – AL1 (Joint Village Office for Villages in Shuen Wan, Tai Po)

Date	Start Time	1st Leq5m in	2nd Leq5m in	3rd Leq5m in	4th Leq5m in	5th Leq5m in	6th Leq5m in	Leq30min*
4-Dec-13	14:20	-	-	-	-	-	-	68.5
11-Dec-13	15:30	-	-	-	-	-	-	67.4
18-Dec-13	15:05	-	-	-	-	-	-	68.8
27-Dec-13	15:40	-	-	-	-	-	-	69.5
Limit Level					•			> 75 dB(A)

^(*)The monitoring is undertaken under façade situation. No façade correction is added according to acoustical principles and EPD guidelines.

Designated Monitoring Station - M2 (150, San Tau Kok)

Date	Start Time	1 st Leq _{5min}	2 nd Leq _{5min}	3 rd Leq _{5min}	4 th Leq _{5min}	5 th Leq _{5min}	6 th Leq _{5min}	Leq _{30min}	Corrected* Leq _{30min}
6-Dec-13	14:33	65.3	65.6	64.7	64.2	60.0	63.4	64.2	67.2
13-Dec-13	17:41	59.0	64.6	62.6	59.5	61.2	59.7	61.6	64.6
18-Dec-13	16:10	67.4	65.6	66.8	67.1	68.0	67.7	67.2	70.2
27-Dec-13	16:17	66.1	69.3	69.9	70.3	68.4	66.8	68.7	71.7
Limit Level			-						5 dB(A)

^(*) A façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines.

Designated Monitoring Station – M3 (31, Wai Ha)

Date	Start Time	1 st Leq _{5min}	2 nd Leq _{5min}	3 rd Leq _{5min}	4 th Leq _{5min}	5 th Leq _{5min}	6 th Leq _{5min}	Leq _{30min}	Corrected* Leq _{30min}
6-Dec-13	13:57	69.3	61.8	65.8	71.1	66.3	69.1	68.1	71.1
13-Dec-13	17:07	62.3	63.6	65.2	60.2	65.9	64.0	63.9	66.9
18-Dec-13	14:53	61.0	66.0	67.8	64.1	63.9	68.9	66.0	69.0
27-Dec-13	15:59	64.7	66.3	67.1	65.7	62.9	64.9	65.5	68.5
Limit l	Level							> 75	dB(A)

^(*) A façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines.

Designated Monitoring Station – M4 (Block 15, Treasure Spot Garden)

Date	Start Time	1 st Leq _{5min}	2 nd Leq _{5min}	3 rd Leq _{5min}	4 th Leq _{5min}	5 th Leq _{5min}	6 th Leq _{5min}	Leq _{30min}	Corrected* Leq _{30min}
6-Dec-13	14:38	44.1	57.1	55.0	50.3	55.1	62.2	56.9	59.9
13-Dec-13	17:05	55.4	47.4	50.8	48.9	44.7	45.6	50.4	53.4
18-Dec-13	15:33	61.2	60.9	56.7	59.3	58.3	65.1	61.1	64.1
27-Dec-13	16:07	53.2	54.0	52.7	51.3	51.8	52.9	52.7	55.7
Limit I	Level							> 75	dB(A)

 $^{(*)\} A\ façade\ correction\ of\ +3\ dB(A)\ has\ been\ added\ according\ to\ acoustical\ principles\ and\ EPD\ guidelines.$

AUES

DSD Contract No. DC/2010/02 Contract No. - Drainage Improvement in Shuen Wan and Shek Wu Wai Summary of Water Quality Monitoring Results

Location					DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(m	g/L)
W1 (impact)					Action	7.27	Action	n/a	Action	4.77	Action	n/a	Action	9.73
w i (impact)					Limit	4	Limit	n/a	Limit	5.26	Limit	n/a	Limit	10.77
W2 (impact)					Action	7.26	Action	n/a	Action	2.46	Action	n/a	Action	8.89
wz (impact)		Action/ Limi	t Level		Limit	4	Limit	n/a	Limit	3.42	Limit	n/a	Limit	9.75
W3 (control)					n	/a	n.	/a	n.	/a	n	ı/a	n/	a
W4 (impact)					Action	9.27	Action	n/a	Action	3.32	Action	n/a	Action	6.98
W4 (impact)					Limit	4	Limit	n/a	Limit	4.52	Limit	n/a	Limit	7.66
Date	2-Dec-13													
Location	Time	Time Depth (m) Temp (oC)				ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	g/L)
W1 - ebb	11:36	0.25	19.1	19.1	7.79	7.8	83.2	83.8	4.9	4.7	8.11	8.1	5	5.0
(impact)	11.30	0.25	19.1	19.1	7.87	7.0	84.4	03.0	4.51	4.7	8.13	0.1	5	5.0
W1- flood	17:00	0.33	21.5	21.5	6.21	6.2	69.1	69.0	4.58	4.6	7.56	7.6	5	5.0
(impact)	17.00	0.55	21.5	21.0	6.19	0.2	68.8	07.0	4.6	4.0	7.57	7.0	5	5.0
W2 (Impact)	13:00	<1	18.1	18.1	7.38	7.4	75	75.0	3.3	3.3	7.75	7.8	2.6	2.6
WZ (Impact)	10.00	``	18.1	10.1	7.38	77	75	70.0	3.3	0.0	7.75	7.0	2.6	2.0
W3 (control)	17:30	30 0.06 17.8 17.8			8.11	8.1	82.7	82.2	1.81	2.2	8.93	8.9	4	4.0
(00:111:01)		0.00	17.8	17.0	7.99	0	81.6	OL.L	2.52		8.92	0.7	4	110
W4 (impact)	17:45	0.12	17	17.0	8.59	8.5	84.9	84.1	3.15	3.1	8.87	8.9	3	3.0
(npaot)	0	2.12	17		8.42	2.0	83.3		3.09		8.87	2.7	3	2.0

Date	4-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	g/L)
W1 - ebb (impact)	13:08	0.14	20.3	20.3	8.49 8.42	8.5	92.7 90.9	91.8	4.09 3.6	3.8	7.48 7.48	7.5	4	4.0
W1- flood (impact)	8:00	0.37	20.5 20.5	20.5	8.41 8.38	8.4	92 91.8	91.9	3.52 3.42	3.5	8.06 8.06	8.1	4	4.0
W2 (Impact)	14:25	<1	20.8 20.8	20.8	7.47 7.47	7.5	75 75	75.0	2.8	2.8	8.01 8.01	8.0	1.4 1.4	1.4
W3 (control)	16:50	0.23	20.7 21.7	21.2	6.25 6.23	6.2	70.3 70.2	70.3	2.63 2.82	2.7	8.04 8.04	8.0	3	3.0
W4 (impact)	16:45	0.45	21.4 21.4	21.4	6.89 6.84	6.9	79.8 79.4	79.6	1.67 1.84	1.8	8.38 8.37	8.4	3	3.0

Date	6-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	g/L)
W1 - ebb (impact)	14:46	0.16	21.5 21.5	21.5	7.71 7.66	7.7	84.3 84	84.2	15.5 15.9	15.7	7.66 7.67	7.7	16 16	16.0
W1- flood (impact)	9:18	0.32	18.9 18.9	18.9	6.56 6.29	6.4	72.2 62.5	67.4	14.9 16.1	15.5	7.44 7.45	7.4	16 16	16.0
W2 (Impact)	15:20	<1	18.5 18.5	18.5	7.21 7.21	7.2	73 73	73.0	3.9 3.9	3.9	7.65 7.65	7.7	11 11	11.0
W3 (control)	13:49	0.06	23.5 23.5	23.5	7.87 7.93	7.9	90.8 91.3	91.1	3.11 3.75	3.4	9.08 9.06	9.1	2	2.0
W4 (impact)	14:06	0.08	22.5 22.5	22.5	9.01 9.16	9.1	100.5 101.7	101.1	2.49 2.16	2.3	8.73 8.73	8.7	3	3.0

Date	9-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(m	g/L)
W1 - ebb	17:47	0.24	22.3	22.3	7	7.1	77.9	78.4	4.49	4.6	7.77	7.8	6	6.0
(impact)	17.47	0.24	22.3	22.5	7.15	7.1	78.9	70.4	4.79	4.0	7.78	7.0	6	0.0
W1- flood	11:58	0.31	20.9	20.9	6.84	6.8	75.2	74.6	3.15	3.1	7.46	7.5	4	4.0
(impact)	11.36	0.31	20.9	20.9	6.71	0.0	73.9	74.0	3	3.1	7.46	7.5	4	4.0
W2 (Impact)	16:00	<1	21.5	21.5	6.98	7.0	75	75.0	4.5	4.5	7.8	7.8	12	12.0
WZ (IIIIpact)	10.00	< 1	21.5	21.0	6.98	7.0	75	75.0	4.5	4.5	7.8	7.0	12	12.0
W3 (control)	10:52	0.16	21.8	21.8	8.71	8.7	97	96.2	1.87	2.2	8.56	8.6	<2	2.0
ws (control)	10:52	0.16	21.8	21.8	8.62	8.7	95.4	90.2	2.43	2.2	8.55	8.0	<2	2.0
M/4 (immost)	10:44	0.24	22	22.0	8.79	8.8	99.6	99.8	2.69	2.6	8.69	8.7	<2	2.0
W4 (impact)	10:44	0.24	22	22.0	8.84	8.8	100	99.8	2.43	2.0	8.68	8.7	<2	2.0

Date	11-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(m	g/L)
W1 - ebb	9:05	0.33	19.9	19.9	7.97	8.0	85.9	86.3	3.93	4.0	8.19	8.2	4	4.0
(impact)	7.03	0.33	19.9	17.7	8.05	0.0	86.7	00.5	4.08	4.0	8.18	0.2	4	4.0
W1- flood	12:58	0.42	21.1	21.1	7.07	7.1	76	76.4	4.57	4.5	8.03	8.0	4	4.0
(impact)	12.36	0.42	21.1	21.1	7.13	7.1	76.7	70.4	4.43	4.5	8.02	6.0	4	4.0
W2 (Impact)	15:00	<1	21.5	21.5	7.89	7.9	85	85.0	3.5	3.5	8.15	8.2	9.4	9.4
vvz (IIIIpact)	15.00	< 1	21.5	21.5	7.89	7.9	85	65.0	3.5	3.0	8.15	0.2	9.4	9.4
W3 (control)	13:17	0.08	20.7	20.7	8.13	8.1	89.9	89.7	7.83	8.0	8.94	8.9	9	9.0
W3 (COITHOI)	13.17	0.06	20.7	20.7	8.1	0.1	89.4	09.7	8.16	6.0	8.93	0.9	9	9.0
M/4 (improat)	13:29	0.07	20.2	20.2	8.59	8.7	94	94.5	10.9	10.5	8.48	8.5	9	9.0
W4 (impact)	13:29	0.07	20.2	20.2	8.74	0.7	95	74.5	10.1	10.5	8.49	0.5	9	9.0

Date	13-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	DO (ı	mg/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	ıg/L)
W1 - ebb	10:02	0.38	21.3	21.3	6.19	6.2	65	65.5	4.72	4.5	7.57	7.6	8	8.0
(impact)	10.02	0.30	21.3	21.3	6.24	0.2	66	05.5	4.32	4.5	7.55	7.0	8	0.0
W1- flood	15:34	0.46	19.2	19.2	5.08	5.1	54.1	54.1	3.88	3.9	7.26	7.3	7	7.0
(impact)	13.34	0.40	19.2	19.2	5.11	5.1	54.1	34.1	3.84	3.9	7.26	7.3	7	7.0
W2 (Impact)	10:25	<1	22.9	22.9	7.16	7.2	75	75.0	4.1	4.1	7.48	7.5	3.8	3.8
wz (iiipaci)	10.25	< 1	22.9	22.9	7.16	1.2	75	75.0	4.1	4.1	7.48	7.5	3.8	3.0
W3 (control)	17:03	0.08	19.2	19.2	9.27	9.3	104.1	104.1	1.17	1 1	8.29	8.3	5	5.0
ws (control)	17:03	0.08	19.2	19.2	9.24	9.3	104	104.1	1.09	1.1	8.28	8.3	5	5.0
W4 (impact)	17:10	0.09	20	20.0	8.97	8.9	97.1	97.0	10.3	9.5	8.33	8.3	7	7.0
w4 (impact)	17:10	0.09	20	20.0	8.9	0.9	96.8	91.0	8.62	7.5	8.34	0.3	7	7.0

DSD Contract No. DC/2010/02 Contract No. - Drainage Improvement in Shuen Wan and Shek Wu Wai Summary of Water Quality Monitoring Results

AUES

Location		DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(m	g/L)
W1 (impact)		Action	7.27	Action	n/a	Action	4.77	Action	n/a	Action	9.73
w i (iiiipact)		Limit	4	Limit	n/a	Limit	5.26	Limit	n/a	Limit	10.77
W2 (impact)		Action	7.26	Action	n/a	Action	2.46	Action	n/a	Action	8.89
wz (impact)	Action/ Limit Level	Limit	4	Limit	n/a	Limit	3.42	Limit	n/a	Limit	9.75
W3 (control)		n	/a	n,	/a	n/	/a	n	/a	n/	a
W4 (impact)		Action	9.27	Action	n/a	Action	3.32	Action	n/a	Action	6.98
TT (((mpdot)		Limit	4	Limit	n/a	Limit	4.52	Limit	n/a	Limit	7.66

Date	16-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	ıg/L)
W1 - ebb (impact)	12:23	0.29	15.4 15.4	15.4	7.25 7.03	7.1	80.3 77.4	78.9	18.2 18.9	18.6	7.32 7.31	7.3	13 13	13.0
W1- flood (impact)	17:19	0.38	16.2 16.2	16.2	5.94 5.86	5.9	65.3 64.5	64.9	23.1 23	23.1	7.19 7.18	7.2	26 26	26.0
W2 (Impact)	13:00	<1	20.3 20.3	20.3	7.21 7.21	7.2	78 78	78.0	3.6 3.6	3.6	7.71 7.71	7.7	3.8 3.8	3.8
W3 (control)	16:47	0.24	15.7 15.7	15.7	9.38 9.14	9.3	105.4 102.7	104.1	9.3 9.71	9.5	8.39 8.38	8.4	8	8.0
W4 (impact)	17:02	0.31	16 16	16.0	9.83 9.46	9.6	110.5 106.2	108.4	9.14 9.18	9.2	7.97 7.97	8.0	26 26	26.0

Date	18-Dec-13		·	·								·	·	·
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(m	g/L)
W1 - ebb (impact)	13:18	0.24	14.2 14.2	14.2	8.34 8.4	8.4	84.7 84.4	84.6	3.68 3.54	3.6	7.42 7.43	7.4	3	3.0
W1- flood (impact)	16:36	0.32	12.1 12.1	12.1	7.19 7.31	7.3	72.6 74.4	73.5	4.61 4.44	4.5	7.27 7.28	7.3	9	9.0
W2 (Impact)	13:45	<1	16.7 16.7	16.7	7.31 7.31	7.3	78 78	78.0	3.1 3.1	3.1	7.87 7.87	7.9	2.2	2.2
W3 (control)	15:20	0.19	13.4 13.4	13.4	9.01 8.96	9.0	84.2 82.9	83.6	2.83 2.81	2.8	8.75 8.74	8.7	<2 <2	2.0
W4 (impact)	15:24	0.25	12.7 12.7	12.7	9.19 9.13	9.2	84.3 82.9	83.6	3.35 3.12	3.2	8.65 8.64	8.6	3	3.0

Date	20-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	ıg/L)
W1 - ebb (impact)	13:48	0.39	17.3 17.3	17.3	6.16	6.1	66.4	66.3	1.82 1.73	1.8	6.95 6.96	7.0	<2 <2	2.0
W1- flood (impact)	9:30	0.21	16.2 16.2	16.2	6.8 6.71	6.8	73.3 72.4	72.9	1.5 1.65	1.6	6.8	6.8	2	2.0
W2 (Impact)	15:00	<1	17.6 17.6	17.6	7.21 7.21	7.2	75 75	75.0	3.5 3.5	3.5	7.89 7.89	7.9	5 5	5.0
W3 (control)	13:00	0.09	17.9 17.9	17.9	6.18 6.17	6.2	66.7 66.6	66.7	19.2 22.5	20.9	8.07 8.06	8.1	12 12	12.0
W4 (impact)	13:20	0.05	17.6 17.6	17.6	5.53 5.55	5.5	59.8 60	59.9	3.13 3.22	3.2	7.52 7.51	7.5	10 10	10.0

Date	23-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	g/L)
W1 - ebb (impact)	16:00	0.12	18.1 18.1	18.1	7.94 7.9	7.9	86 85.6	85.8	3.97 3.99	4.0	6.23	6.2	8	8.0
W1- flood (impact)	10:15	0.39	16.9 16.9	16.9	6.16 6.14	6.2	66.6 66.4	66.5	3.93 3.74	3.8	6.81 6.81	6.8	8	8.0
W2 (Impact)	16:00	<1	17.5 17.5	17.5	7.16 7.16	7.2	70 70	70.0	3.5 3.5	3.5	7.79 7.79	7.8	3.8	3.8
W3 (control)	16:30	0.12	17.2 17.2	17.2	7.22 7.12	7.2	78.2 77.2	77.7	5.84 5.39	5.6	8.45 8.44	8.4	10 10	10.0
W4 (impact)	16:41	0.10	17.4	17.4	7.33	7.3	79.7	79.7	4.17	4.2	7.72	7.7	9	9.0

Date	27-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	y (NTU)	p	Н	SS(m	g/L)
W1 - ebb (impact)	9:00	0.22	16.4 16.4	16.4	9.56 9.94	9.8	95.7 99.4	97.6	6.76	6.4	8.34 8.36	8.4	10 10	10.0
W1- flood (impact)	14:28	0.38	16.9 16.9	16.9	8.83 8.72	8.8	89 87.4	88.2	11 12.2	11.6	8.05 8.06	8.1	12 12	12.0
W2 (Impact)	14:55	<1	17.3 17.3	17.3	8.11 8.11	8.1	85 85	85.0	3.1 3.1	3.1	7.88 7.88	7.9	2	2.0
W3 (control)	16:55	0.05	18.4 18.4	18.4	9.78 9.43	9.6	96.5 99.9	98.2	1.93 1.57	1.8	8.27 8.26	8.3	5 5	5.0
W4 (impact)	17:09	0.08	15.7 15.7	15.7	11.68 11.83	11.8	113.9 115.3	114.6	1.98 2.08	2.0	7.92 7.92	7.9	5 5	5.0

Date	30-Dec-13													
Location	Time	Depth (m)	Temp	(oC)	1) OD	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(m	ıg/L)
W1 - ebb (impact)	10:25	0.20	15.3 15.3	15.3	7.69 7.56	7.6	80.9 79.3	80.1	2.94 3.07	3.0	7.19 7.2	7.2	2	2.0
W1- flood (impact)	15:45	0.34	17.7 17.7	17.7	7.91 8.01	8.0	85.4 86.7.5	85.4	3.85 4.02	3.9	7 7	7.0	3	3.0
W2 (Impact)	11:30	<1	19.1 19.1	19.1	7.34 7.34	7.3	75 75	75.0	4.5 4.5	4.5	7.68 7.68	7.7	2.6 2.6	2.6
W3 (control)	16:13	0.29	16.6 16.6	16.6	7.73 7.55	7.6	76.7 75.1	75.9	1.21 1.11	1.2	8.24 8.23	8.2	<2 <2	2.0
W4 (impact)	16:37	0.17	17.6 17.6	17.6	8.51 8.64	8.6	86.2 87.7	87.0	2.41 2.38	2.4	8.01 8.02	8.0	<2 <2	2.0




Appendix J


Graphical Plots of Impact Monitoring – Noise, Water Quality and Hydrological Characteristics




Graphic Plot – Construction Noise

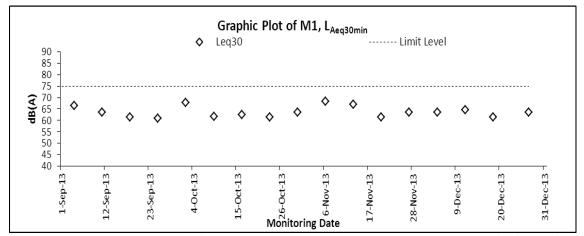

Remark: The monitoring is undertaken under façade situation. No façade correction is added according to acoustical principles and EPD guidelines.

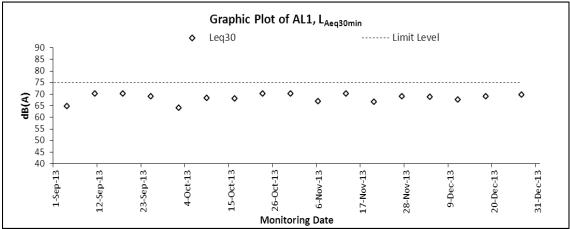


Remark: The monitoring is undertaken under façade situation. No façade correction is added according to acoustical principles and EPD guidelines.

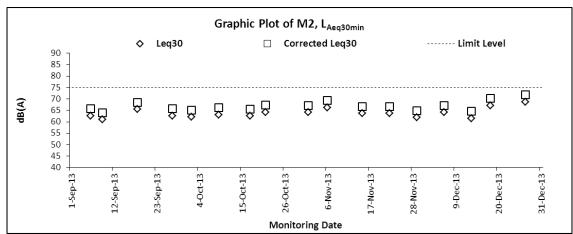


Remark: The monitoring is undertaken under free field situation. A façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines.



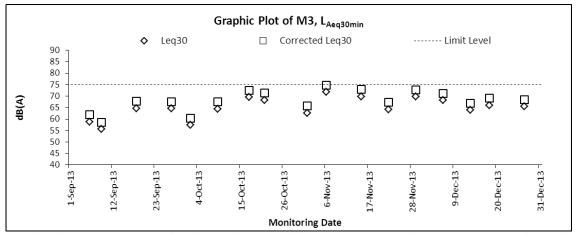


Remark: The monitoring is undertaken under free field situation. A façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines

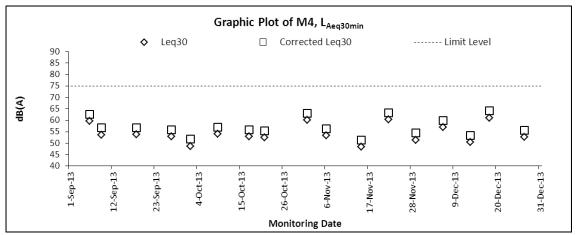



Remark: The monitoring is undertaken under free field situation. A façade correction of +3 dB(A) has been added according to acoustical principles and EPD guidelines




Graphic Plot – Water Quality

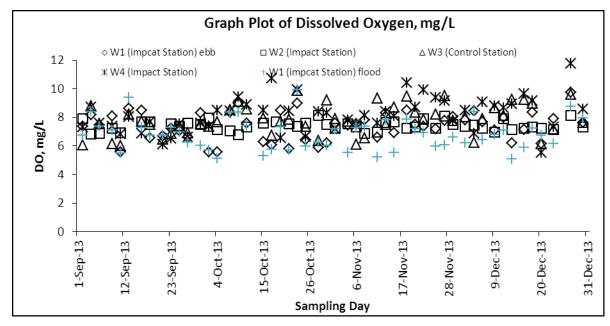

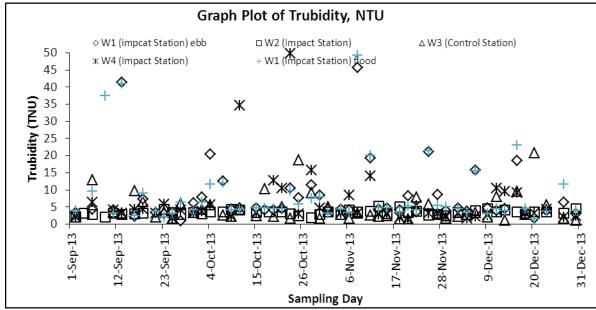

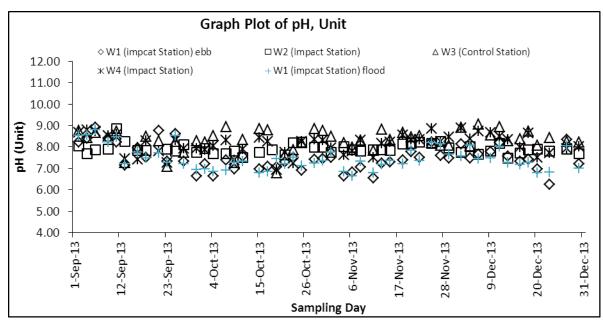





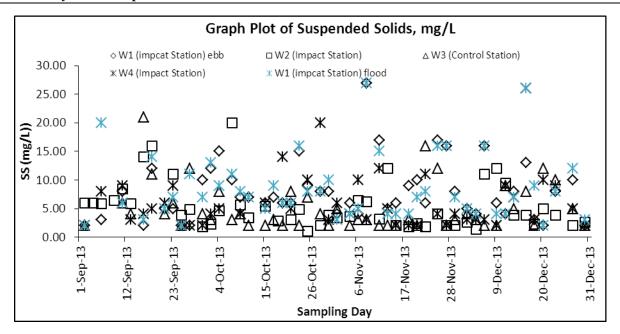




Graphic Plot – Hydrological Characteristics (Water Depth)

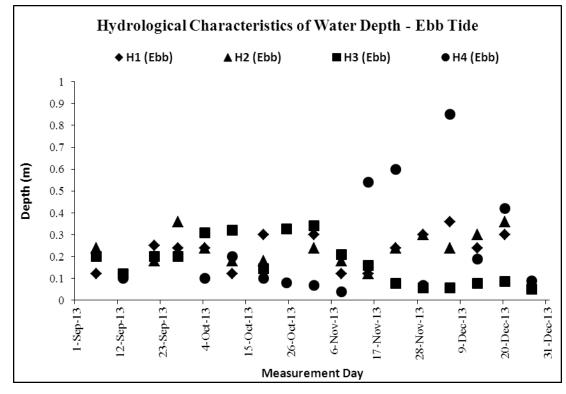


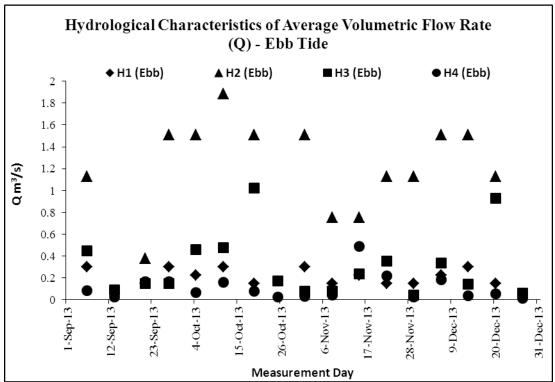



Graphic Plot – Hydrological Characteristics (Water Flow Rate)

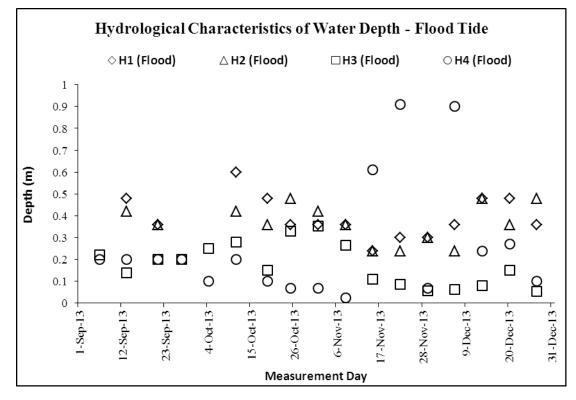

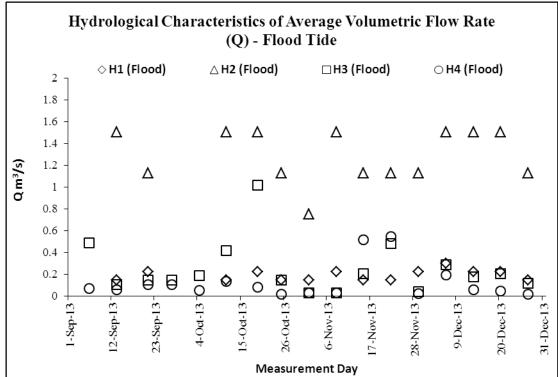



Appendix K

Monthly Summary Waste Flow Table

Month	~	Actual Quantities of Inert C&D Materials Generated Monthly Hard Rock and Reused in the Large Broken the Concrete Contract Cin 1000m-3 (in 1000m-3)	of Inert C& Reused in the Contract	Inert C&D Materials Generated Monthly Leused in the Projects Public Fill Contract Projects Public Fill Contract Projects Public Fill	erated Month Disposed as Public Fill		nthly as Imported Fill	mported Fill	mported Fill Metals	Actual Quantities of C&D Wastes Paper/ Plastics cardboard (see Note 3)	Actual Quantities of C&D Wastes G Reported Fill Metals cardboard packaging (see Note 3) Reported Fill packaging (see Note 3)
Anr 2011	(in '000m²)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)		(in '000m³)) (in '0) (in '000 kg) () (in '000 kg) (in '000kg) (in '0) (în '000 kg) (în '000kg) (în '000kg) (în '
May 2011	NI:	0	0	0	0		0	0 0		0	0 0
June 2011	Zi	0	0	0	0		0		0	0 0	0 0 0
July 2011	NI	0	0	0	0		0		0	0 0	0 0 0
Aug 2011	0.7855	0	0	0.7855	0		0		0	0 0	0 0 0
Sept 2011	Nil	0	0	0	0		0		0	0 0	0 0 0
Oct 2011	N:i	0	0	0	0		0		0	0 0	0 0 0
Nov 2011	Nii	0	0	0	0		0	0 0		0	0 0 0
Dec 2011	0.08	0	0	0	0.08		0		0	0 0	0 0 0
Jan 2012	Nil	0	0	0	0		0	0 0		0 0	0 0
Feb 2012	0.01	0	0	0	0.01		0		0	0 0	0 0 0
Mar 2012	0.405	0	0	0	0.405	· · · · · · · · · · · · · · · · · · ·	0		0	0 0	0 0 0
Apr 2012	0.005	0	0	0	0.005	- 1	0		0	0 0	0 0 0
May 2012	0.165	0	0	0	0.165		0	0 0		0	0 0
June 2012	0.145	0	0	0	0.145	f	0	0 0		0 0	0 0 0
July 2012	0.005	0	0	0	0.005	i	0			0 0	0 0 0
Aug 2012	0.775	0	0	0	0.775		0	0 0		0 0	0 0 0
Sept 2012	0.21	0	0	0	0.21		0	0 0		0 0	0 0 0
Oct 2012	0.49	0	0	0	0.49		0	0 0		0	0 0
Nov 2012	0	0	0	0	0		0	0 0		0	0 0
Dec 2012	0	0	0	0	0		0	0 0		0	0 0
Jan 2013	0.035	0	0	0	0.035		0	0 0		0	0 0
Feb. 2013	0.035	0	0	0	0.035		0	0 0		0	0 0
Mar. 2013	0.002	0	0	0	0.002		0	0 0		0	0 0
Apr. 2013	0.31	0	0	0	0.31		0	0 0		0	0 0
May. 2013	0.04	0	0	0	0.04	+	0	0 0		0	0 0
June 2013	0.37	0	0	0	0.37		0	0 0		0	0 0

Kwan Lee - Kuly Joint Venture
Environmental Management Plan for Contract No. DC/2010/02
Drainage Tunrovement Works in Shien was and Shek Wi Wai

Drainage	ij	Works in Si	nuen Wan an	d Shek Wu W	9 .		ALL THE PROPERTY OF THE PROPER		Z.	Name of Depart	artment: DSD
July 2013	0.015	0	0	0	0.015	0	0	0	0	0	0.01
Aug 2013	0	0	0	0	0	0	0	0	0	0	0
Sep 2013	0.036	0	0	0	0.036	0	0	0	0	0	0
Oct 2013	0.301	0	0	0	0.301	0	0	0	0	0	0
Nov 2013		0	0	0	0.215	0	0	0	0	0	0.00525
Dec 2013	0.333	0	0	0	0.333	0	0	0	0	0	0.0045
Total	4.768	0	0	0.7855	3.983	0	0	-	•	0	0.2945

23	(in '000m ³)	Total Quantity Generated	
,	(in '000m³)	Hard Rock and Large Broken Concrete	
10	(in '000m³)	Reused in the Contract	
0	(in '000m³)	Reused in other Projects	Forecast o
10	(in '000m³)	Disposed as Public Fill	f Lotal Quanti
2	(in '000m^3)	Imported Fill	Forecast of Total Quantities of C&D Materials to be Generated from the
ა	(in '000 kg)	Metals	erials to be G
2	(in '000kg)	Paper/ cardboard packaging	enerated from the
 ,	(in '000kg)	Plastics (see Note 3)	e Contract*
)	(in '000kg)	Chemical Waste	
 ω	(in '000m³)	Others, e.g. general refuse	

Notes:

- The performance targets are given in ETWB Technical Circular PS Clause 6(14).

 The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material
- ۯ@**€** The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m3. (ETWB Technical Circular PS Clause 5(4)(b) refers). [Delete Note (4) and the table above on the forecast, where inapplicable].

Name of Department: DSD

Summary Table for Work Processes or Activities Requiring Timber for Temporary Works

Contract No. : <u>DC/2010/02</u>

Contract Title: Drainage Improvement Works in Shuen Wan and Shek Wu Wai

	,œ	7.	6.	5.	4.	<u>.</u>	2.	-	Item No.
								Formwork for concreting	Description of Works Process or Activity [see note (a) below]
Total Estimated Quantity of Timber Used								Easy handle by manpower	Justifications for Using Timber in Temporary Construction Works
2.71								2.71	Est. Quantities of Timber Used (m3)
								2.7	Actual Quantities used (m3)
									Remarks

Notes:

Ġ

- ţ The Contractor shall list out all the work items requiring timber for use in temporary construction works. Several minor work items may be grouped into one for ease
- The summary table shall be submitted to the *Architect/Engineer's Representative monthly together with the Waste Flow Table for review and monitoring in accordance with the ETWB Technical Circular 19/2005 PS sub-clause 5(5) in Appendix C.



Appendix L

Monthly Landscape & Visual Inspection Report

Contract No. DC/2010/02 Drainage Improvement Works in Shuen Wan and Shek Wu Wai Bi-weekly Landscape & Visual Monitoring

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

Job Ref.: 09/317/161D KLKJV-SW

Date: January 2014



Contract No. DC/2010/02 Drainage Improvement Works in Shuen Wan and Shek Wu Wai Bi-weekly Landscape & Visual Monitoring

EM&A (Landscape & Visual) Report (December 2013)

(Issue 1)

January 2014

	Name	Signature
Prepared by:	Sean FONG	4
Reviewed by:	Ida YU	Salph
Date:	8 th January 2014	

Job Ref.: 09/317/161D KLKJV-SW

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

CONTENTS

1	INTRODUCTION	1
2	SCOPE OF MONITORING	. 1
- 3	LANDSCAPE & VISUAL MONITORING RESULTS	2
	AUDIT SCHEDULE	

LIST OF APPENDICES

Appendix A – Photographs



Contract No. DC/2010/02

Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

1 INTRODUCTION

- 1.1.1 The Landscape and Visual Monitoring of the Project is conducted to fulfill Clauses 5.2 and 5.4 of EP-303/2008 and the monitoring requirements in accordance with Section 7 of the approved updated EM&A Manual (approved by EPD on 31st May 2012) of the Project. A Baseline Review on updating the landscape and visual condition, and the mitigation measures of the Project (including Contracts 1 and 2 of the Project) was undertaken before the commencement of the Project. The review findings were updated in the Baseline Environmental Monitoring Report submitted to the EPD on 14th February 2011.
- 1.1.2 This monthly monitoring report will detail the scope of landscape and visual monitoring work, monitoring findings and observations, and any recommendation and advice on proper implementation of the landscape mitigation measures in the works areas under Contract 2 of the Project.

2 SCOPE OF MONITORING

2.1 Monitoring objectives

2.1.1 Landscape and Visual Monitoring of the Project should be conducted on a bi-weekly basis for checking the design, implementation and maintenance of the landscape and visual mitigation measures throughout the construction phase and in a quarterly basis during operational phase of the Project. Observations of any potential conflicts between the proposed mitigation measures and the project works carried out by the Contractors should be recorded. Recommendation and advice on proper implementation of the landscape mitigation measures should be provided to the Contractor for minimizing any potential impacts on the landscape and visual elements.

2.2 Monitoring during Construction Phase

- 2.2.1 The following landscape and visual mitigation measures should be implemented during the construction phase of the project to minimize the potential impacts:
 - Visual Screen Use of hoardings as visual screens for the construction in the works areas;
 - Contaminant/ Sediment Control Use of temporary barriers, covers and drainage
 provision around the construction works as contaminant/ sediment control to prevent
 the contaminants and sediments from entering the sensitive water-based habitats;
 - Pollution Control Implementation of pollution control measures to minimize any adverse environmental impacts to the surrounding habitats;
 - Liaison with Nursery (Not relevant to Contract 2 of the Project) Liaison with the
 nursery operator as necessary to minimize any adverse impact to the daily operation
 and plant holding capacity of the nursery;
 - Existing Trees within Works Area Maintenance and protection of the existing trees, especially their crowns, trunks and roots, within work sites; and
 - Construction Light Provision of construction light should be controlled at night to avoid excessive glare to the surrounding villages and to Plover Cove.



Contract No. DC/2010/02

Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

2.3 Monitoring during Operational Phase

- 2.3.1 The following landscape and visual mitigation measures should be implemented during the operational phase of the project to minimize the potential impacts:
 - Viewing area formation by planting with shrubs, grasses and benches along the area;
 - Architectural design of the pump house will help it fit into the existing suburban, natural
 to semi-natural surroundings (Not relevant to Contract 2 of the Project);
 - Landscape design of pump house by providing sufficient planting around its boundary fence (Not relevant to Contract 2 of the Project);
 - Enhancement planting along Tung Tsz Road with shrubs/ trees of suitable species to help protect the stream and marshes;
 - Construction of box culvert should be with at least 1.0m soil depth for enhancement planting;
 - Transplanting of existing affected trees to adjacent locations should be carried out;
 - Preparation for transplanting is needed to allow sufficient time for root pruning and rootball preparation prior to transplanting; and
 - Reinstatement of affected area should be carried out to check that the works areas are properly reinstated.

3 LANDSCAPE & VISUAL MONITORING RESULTS

3.1 Monitoring Date(s)

- 3.1.1 This monthly Landscape and Visual Monitoring (December 2013) was conducted to cover only areas of Contract 2 of the Project (i.e. the construction of a twin-cell box culvert close to Shuen Wan Conservation Area and Wai Ha River along Tung Tsz Road, and a drainage pipe near Wai Ha Village). The bi-weekly monitoring was conducted on 11th and 27th December 2013.
- 3.1.2 All photos stated in this section are recorded in **Appendix A**.

3.2 Visual Screen

3.2.1 No follow-up action by the Contractor is required as from the *Monthly EM&A Report for November 2013*.

Observation

- 3.2.2 Temporary hoardings, in the form of construction barriers, have been erected from west to east parts along Tung Tsz Road from the opposite side of Wai Ha to the opposite side of San Tau Kwok. The construction works along the access road from Tung Tsz Road towards Treasure Spot Garden II have also been demarcated with temporary construction barriers. Another section of temporary hoardings has been erected next to the path outside Treasure Spot Garden II. **Photos 1-2** show the views of the erected hoardings along the active works area under Contract 2.
- 3.2.3 Construction works for building the box culverts have continued in the works area along Tung Tsz Road opposite to Wai Ha outside the public toilet (**Photo 3**).



Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

- 3.2.4 Construction works continued along Wai Ha River (**Photo 4**). The river was still divided by sand bags and water from the upper stream was pumped to the lower stream behind the works area (**Photo 5**).
- 3.2.5 To the southeast of Jade View Villa and adjacent to the current active works area, a demarcated wetland rehabilitation area has been maintained by parties other than the Project Proponent, the Project's Contractor and Sub-contractors since January 2012. Temporary construction barriers were surrounding the eastern side of the area (**Photo 6**). A filtration tank was still found next to the area in December 2013 (**Photo 7**). Underground water from the box culvert was found pumping into the tank and then releasing to the adjacent grassland. The discharge was clear as observed during the monitoring.
- 3.2.6 The temporary parking area was still maintained at the end of the access path to Treasure Spot Garden Phase II in December 2013 (**Photo 8**). The untagged leaning tree was still guyed at the edge of the area within a Tree Protection Zone (TPZ), which was demarcated by orange construction nets (**Photo 9**). Vehicles were parked very close to the TPZ.
- 3.2.7 As reported in the previous *Monthly EM&A Reports*, dumping on the Taro field located along the path towards the Treasure Spot Garden was observed and a paved area created for parking next to the retained tree groups (T088 T091) has been found since November 2012. In October 2013, the path to Treasure Spot Garden II was expanded towards the Taro field due to the reprovision of vehicular access road to the villagers during the works at the entrance of the Treasure Spot Garden. No more expansion of the pathway was seen in December 2013.
- 3.2.8 Works were observed at the end of the Treasure Spot Garden II near the retained tree T103 and the works area was surrounded by temporary construction barriers and chain-link fence (**Photo 10**). Active construction works were also seen on the pathway to the Treasure Spot Garden II near the retained tree group (T097-098) (**Photo 11**). The works area was also surrounded by temporary construction barriers.
- 3.2.9 No hoardings have been erected along the rest of the proposed works area since neither construction works nor any associated preparation works have been commenced.

Recommendations

- 3.2.10 No specific recommendation is required. However, with regard to the previous dumping incident by other parties on the Taro field near the Treasure Spot Garden, the Contractor is recommended to check the site condition regularly to avoid any extent of dumping or paving of area within the project boundary.
- 3.2.11 The Contractor should also make sure there are no piled rocks, construction materials or programmed construction works influencing the existing trees within the Project Area or the wetland rehabilitation area. Otherwise, the Contractor should request the on-site workers to remove those piled rocks or construction materials.
- 3.2.12 The Contractor could establish a warning sign to remind the driver to beware of the presence of the tree(s) close to the temporary parking area.

3.3 Contaminant/ Sediment Control



Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

3.3.1 A series of sedimentation beds with gravels have been built along the boundary of the active works area to the south of Wai Ha and close to Tung Tsz Road in accordance with the recommendation stated in the *Monthly EM&A Report for November 2013*.

Observation

- 3.3.2 The exit points of Contract 2 works area opposite to the tree group T021-029 (*Leucaena leucocephala*) were still maintained December 2013 (**Photo 12**). Workers were seen washing the wheels of the vehicles which were leaving the works area.
- 3.3.3 A sedimentation tank was seen receiving the waste water from the works area near the previous collapsed tree T196 (*Macaranga tanarius* var. *tomentosa*) and the discharge was seen to be clear (**Photo 13**).
- 3.3.4 The sedimentation bed aligned from the area opposite to the Jade View Villa towards the marsh area at southeast (**Photo 14**) and another aligned from the area opposite to the eastern part of Jade View Villa towards the marsh area (**Photo 15**) were abandoned and no more muddy water was discharged into the drainage points. Both beds were overgrown by dense grassy vegetation.
- 3.3.5 As mentioned above, construction works have been resumed along Wai Ha River. The muddy water from the works area was pumped out from the river and back to a sedimentation tank settled at the end of the works area (**Photo 16**). As observed in December 2013, the water was directed along the river and pumped to the grassland behind the tree group T181-183 (**Photo 17**), and the discharge was clear. The remaining water pumped from the upper stream was released back to the river near the sedimentation tank. Sections of granules with underlaid PVC liners were found along the river for further sedimentation but several sections of granules were washed away (**Photo 18**). The water was still noted clear at the lower stream (**Photo 19**).
- 3.3.6 Water from the box culvert in the works area outside the public toilet was noted pumping out and releasing to Wai Ha River (**Photo 20**). The released water was clear as monitored in December 2013.

Recommendations

- 3.3.7 Regular monitoring should be conducted to ensure no direct discharge or leakage of contaminants or any polluted fluid into the adjacent Wai Ha River and the nearby Shuen Wan marsh. The Contractor should maintain regular check (e.g. daily) on the sedimentation and filtration facilities and appropriate sedimentation beds and/or tanks throughout the construction phase (e.g. check the function of the sedimentation beds and remove surplus sand and gravels deposited along the beds or within the tanks) to make sure all discharged water was filtered appropriately prior to any discharge.
- 3.3.8 The Contractor should have *ad hoc* inspection and emergency measures for any accidental spillage of polluted fluid, contaminants or grease from the construction sites. To prevent the impact of the unclear discharge on the nearby vegetated area, it is suggested to overlay PVC liners along the site edge and remove any surplus sand and gravels deposited in the beds and tank even some parts of the construction works may be completed at this stage.

3.4 Pollution Control



Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

3.4.1 No follow-up action by the Contractor is required as from the Monthly EM&A Report for November 2013.

Observation

- 3.4.2 As mentioned in Section 3.3, a sedimentation tank was seen receiving the waste water from the works area near the previous collapsed tree T196 (*Macaranga tanarius* var. *tomentosa*) and the discharge was seen to be clear (**Photo 13**).
- 3.4.3 The sedimentation bed aligned from the area opposite to the Jade View Villa towards the marsh area at southeast (**Photo 14**) and another aligned from the area opposite to the eastern part of Jade View Villa towards the marsh area (**Photo 15**) were abandoned and no more muddy water was discharged into the drainage points. Both beds were overgrown by dense grassy vegetation.
- 3.4.4 As mentioned above, construction works have been started again along Wai Ha River. The muddy water from the works area was pumped out from the river and back to a sedimentation tank settled at the end of the works area (**Photo 16**). As observed in December 2013, the water was directed along the river and pumped to the grassland behind the tree group T181-183 (**Photo 17**), and the discharge was clear. The remaining water pumped from the upper stream was released back to the river near the sedimentation tank. Sections of granules with underlaid PVC liners were found along the river for further sedimentation but several sections of granules were washed away (**Photo 18**). The water was still noted clear at the lower stream (**Photo 19**).
- 3.4.5 Water from the box culvert in the works area outside the public toilet was noted pumping out and releasing to Wai Ha River (**Photo 20**). The released water was clear as monitored in December 2013.
- 3.4.6 As reported in the previous *Monthly EM&A Reports*, cement mortar and surplus soil in the works area near the public toilet were once spread onto the slope and the vegetation next to Wai Ha River (**Photo 21**).
- 3.4.7 No direct water discharge into the upper stream of Wai Ha River was observed as the active construction works have been concentrated at the lower end of Wai Ha River to the southeast of Tung Tsz Shan Road (**Photo 22**).

Recommendations

- 3.4.8 The Contractor should prevent any contaminants and sediments from entering the sensitive water-based habitats (i.e. Shuen Wan marsh and Wai Ha River) and implement pollution control measures to minimize any adverse environmental impacts to the water body. The Contractor should maintain appropriate sedimentation beds and/or tanks throughout the construction phase. The Contractor should adopt a good site practice in maintaining appropriate sedimentation beds and filtration tanks as recommended in the above Section for Contaminant/ Sediment Control. Muddy water pumped from the works area should be filtered appropriately through sedimentation beds or other filtration system prior to the discharge.
- 3.4.9 The Contractor should have *ad hoc* inspection and emergency measures for any accidental spillage of polluted fluid, contaminants or grease from the construction sites. It is also recommended to overlay PVC liners along the site edge and remove any surplus sand and gravels deposited in the beds and tank so as to prevent the impact of the unclear discharge on



Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

the nearby vegetated area. Moreover, the Contractor should restrict and control the works areas where cement mortar has to be applied, and avoid spraying the cement mortar and chemical fluids on vegetation and waterbody.

3.5 Liaison with Nursery

3.5.1 The construction undertaken within Tung Tsz Nursery is restricted under Contract 1 of the Project. This monitoring item is not applicable to Contract 2 of the Project.

3.6 Existing Trees within Works Areas

3.6.1 Individual trees retained within the active works area have been protected within TPZs. The protection measures generally follow the recommendations stated in the *Monthly EM&A Report for November 2013*. Particular observations are highlighted in the following paragraphs.

Observation

- 3.6.2 Most trees which are proposed to be retained within the Project Area were recorded generally in fair health condition and some of the retained trees were naturally covered by invasive climbers.
- 3.6.3 As stated in Section 3.2, a TPZ was set up with orange construction nets to protect the untagged leaning tree from the newly formed temporary parking area at Treasure Spot Garden Phase II. However, the vehicle was parked close to the TPZ (**Photo 9**).
- 3.6.4 As reported in the *Monthly EM&A Report for November 2013*, the retained trees T167 (*Litsea monopetala*) and T168 (*Celtis sinensis*) were topped after the vegetation clearance in the surrounding works area (**Photo 23**). Both T167 and T168 were in poor health condition with very sparse foliage.
- 3.6.5 The broken branch hanging in the canopy of the retained tree T091 (*Leucaena leucocephala*) was removed as inspected on 27th December 2013 (**Photo 24**).
- 3.6.6 Temporary storage of construction materials was still observed close to the trunk flares and tree trunks of T093 and T094 (both *Litsea cubeba*) in December 2013 (**Photo 25**). The Contractor was informed at the site and he claimed that he would remove the stockpiled construction materials within a week.
- 3.6.7 The relocated tree T190 (*Ficus hispida*) was certified as dead specimen in November 2013. It was found collapsed inside the tree protection zone during the monitoring on 11th December 2013 (**Photo 26**).
- 3.6.8 Construction works at the end of the Treasure Spot Garden have commenced since October 2012. Works have been resumed in the area since October 2013. No more stockpiling were noted close to the trunk base of the retained tree T103 (*Litchi chinensis*) in December 2013 (**Photo 27**).
- 3.6.9 Sheet piling works were conducted within the tree root zone of a retained tree T025 (*Celtis sinensis*) in June 2013. Due to the close proximity of the erected sheet piles to the tree, root damage by the sheet piling works is anticipated. The tree was also over-pruned in June 2013. It has been temporarily guyed by three strings so as to provide additional support to the tree. The condition of the tree was still closely monitored in December 2013 (**Photo 28**). It was



Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

found that the sheet piled next to the tree was removed and soil was backfilled. However, excessive soil was still piled around the root flare of T025 (**Photo 29**).

- 3.6.10 Stockpiling of construction materials was found near the trunk flare of the tree group (T119-122) next to the works area in Wai Ha River (**Photo 30**). The Contractor was informed at the site and he claimed that he would remove the stockpiled construction materials immediately.
- 3.6.11 No significant signs of damage on other existing tree crowns, trunks and roots resulting from the construction works were observed in this monthly monitoring.
- 3.6.12 As Area C under Contract 1 of the Project has been formally handed over to AFCD for management and maintenance since October 2012, no access into the ECA is allowed. Two transplanted shrubs of *Pavetta hongkongensis* (PH-01 and PH-03) were inspected through the fence of Tung Tsz Nursery and they have remained in satisfactory condition (**Photos 31-32**).

Recommendations

- 3.6.13 Within the active works area, maintenance of TPZs for the retained trees and the trees to be transplanted should be continued. Trunk bases of all retained trees should be kept clear, with no stockpiled soil, construction equipments and rubbish allowed around the trunk bases and within the TPZs. If necessary, these retained trees shall be watered regularly to maintain their health. All fallen trees or tree parts of the existing trees maintained within the works area of Contract No. DC/2010/02 should be removed if they pose imminent hazards to the people/property or cause obstruction to the traffic. Any broken tree parts still attached to the trees could be pruned appropriately to prevent their potential hazard to the public and property.
- 3.6.14 Disturbance is prohibited in all TPZs. In any practical circumstances, the contractor should follow Section 8 of Annex 4 of the approved Landscape Plan for protecting the existing trees from any potential damages resulting from the construction works. In addition, the Contractor and the Project Proponent should have routine inspection on any tree remedial works conducted by other party on the trees within the Project Area.
- 3.6.15 The tape and ropes tided on the tree trunk of the retained tree T103 should be removed. If necessary, it is recommended to remove the overgrown climbers on the tree canopy so as to reduce the crown load supported by this tree. As the construction works around T103 was resumed in October 2013, the Contractor should have close monitoring of the stability and health condition of this tree.
- 3.6.16 With regard to the previous tree topping incident on the retained trees T088 and T089, as a reminder, the Contractor is suggested to monitor the trees protected within the project boundary regularly. The Contractor should also be aware of any potential damage on the trees by other contractor(s) undertaking construction work concurrently.
- 3.6.17 Tree topping (like the case for T025, T167 and T168) should be prohibited and the Contractor should appoint qualified landscape contractor to perform appropriate pruning practice. The pruning works should follow any local, national or international standards for pruning works and relevant tree remedial works. Given that the tree roots of T025 could be damaged by previous sheet piling works and the topped tree exists with unbalanced tree form, the long-term tree stability and health condition should be checked after the removal of the sheet piles. In addition, the excessive soil piled close to the trunk flare of T025 should be removed to prevent suffocation of trunk. The Contractor should have close monitoring of tree stability with regard to its unbalanced tree form and health condition. Meanwhile, the Contractor and



Drainage Improvement Works in Shuen Wan and Shek Wu Wai

Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

sub-contractor should carefully design the civil works. Common civil works, such as excavation and sheet piling works should be programmed and designed carefully by taking tree buffer zone into consideration. The works should avoid affecting the tree canopy, trunk and underground root zone with regard to tree dripline as far as possible.

- 3.6.18 As the concrete paved temporary parking area at Treasure Spot Garden Phase II was close to the untagged tree, the roots may be damaged and hence the stability of the tree would be affected. The tree may also be damaged by the parking vehicles. Therefore, the Contractor is advised to provide better tree protection measures such as increasing the buffer zone between the parking area and the trees and establish a warning sign to remind the driver to beware of the presence of trees within the tree protection zone. The health and stability of the tree should also be monitored by the Contractor regularly.
- 3.6.19 As temporary storage of construction materials were noted close to the tree flares of T093, T094, T103 and T119-122 and within their dripline areas, the Contractor is advised to establish proper Tree Protection Zone (e.g. an area of at least 1m from tree trunks) and prohibit any construction works and storage of construction materials within and close to the zone.

3.7 Construction Light

3.7.1 No follow-up action on maintenance of construction light is required as from the *Monthly EM&A Report for November 2013*.

Observation

3.7.2 No construction light impact to the surrounding villages and to Plover Cove as all construction activities and construction sites are halted at 1800. No construction light at night is provided by the Contractor.

Recommendation

3.7.3 No specific recommendation is required.

4 AUDIT SCHEDULE

4.1.1 The next bi-weekly Landscape & Visual Monitoring in January 2014 is scheduled to be conducted in the weeks of 6th and 20th January 2014.



Bi-weekly Landscape & Visual Monitoring

Job Ref.: 09/317/161D KLKJV -SW EM&A (Landscape & Visual) Report (December 2013) (Issue 1)

Appendix A Photographs





Photo 1 – Temporary hoardings have been erected along Tung Tsz Road opposite to Wai Ha.



Photo 2 – Temporary hoardings have been erected along the access road from Tung Tsz Road to Treasure Spot Garden II.



Photo 3 – Construction work for building the box culverts along Tung Tsz Road opposite to Wai Ha outside the public toilet.



Photo 4 – Construction work continued along Wai Ha River.



Photo 5 – The river was divided by sand bags (Red arrow) and water from the upper stream was pumped to the lower stream behind the works area along Wai Ha River (Blue arrow).



Photo 6 – Temporary construction barriers surrounded the eastern side of the wetland rehabilitation area.



Photo 7 – A filtration tank next to the wetland rehabilitation area in December 2013.



Photo 8 – Temporary parking area was still maintained at the end of the access path to Treasure Spot Garden Phase II in December 2013.



Photo 9 – The untagged tree (Red arrow) was guyed at the edge of the parking area within a Tree Protection Zone demarcated by orange construction nets (Blue arrow).



Photo 10 – Works were observed at the end of the Treasure Spot Garden II near the retained tree T103 and the works area was surrounded by temporary construction barriers and chain-link fence.



Photo 11 – Active construction works were also seen on the pathway to the Treasure Spot Garden II near the retained tree group (T097-098).



Photo 12 – One exit point was seen opposite to the tree group T021-029 (*Leucaena leucocephala*).



Photo 13 – A sedimentation tank was seen receiving the waste water from the works area near the previous collapsed tree T196 and the discharge was seen to be clear.



Photo 14 – Abandoned sedimentation bed aligned from the area opposite to the Jade View Villa towards the marsh area at southeast with overgrown dense grassy vegetation.



Photo 15 – Abandoned sedimentation bed aligned from the area opposite to the eastern part of Jade View Villa towards the marsh area with overgrown dense grassy vegetation.



Photo 16 – The muddy water from the works area was pumped out from the river and back to a sedimentation tank settled at the end of the works area.



Photo 17 – The water from the sedimentation tank was directed along the river to the grassland behind the tree group T181-183. The discharge was clear in December 2013.



Photo 18 – Sections of granules with underlaid PVC liners were found along the river for further sedimentation but several sections of granules were washed away.



Photo 19 – The water was still noted clear at the lower stream.



Photo 20 – Water from the box culvert in the works area outside the public toilet was noted pumping out and releasing to Wai Ha River.



Photo 21 – In the works area near the public toilet, cement mortar and surplus soil were spread onto the slope and the vegetation next to Wai Ha River.



Photo 22 – No direct water discharge into the upper stream of Wai Ha River was observed as the construction works have been concentrated at the lower end of the river.



Photo 23 – Topped T167 (Red arrow) and T168 (Blue arrow) were in poor health condition with very sparse foliage.



Photo 24 – A broken branch hanging in the canopy of the retained tree T091 was removed.



Photo 25 – Temporary storage of construction materials was still noted close to the trunk flares and trunks of T093 and T094.



Photo 26 – The dead, relocated tree T190 was found collapsed.



Photo 27 – No more stockpiling was noted close to the trunk base of the retained tree T103.



Photo 28 – The retained tree T025 was pruned before and it was temporarily guyed to provide additional support to this tree.



Photo 29 – Excessive soil was still piled around the root flare of T025.



Photo 30 – Stockpiling of construction materials was found near the trunk flare of the tree group (T119-122) next to the works area in Wai Ha River.

Job Ref.: 09/317/161D KLKJV -SW

EM&A (Landscape & Visual) Report (December 2013) (Issue 1)



Photo 31 – The transplanted shrub of *Pavetta hongkongensis* (PH01) in Area C under Contract 1 remained in satisfactory condition in December 2013.



Photo 32 – The transplanted shrub of *Pavetta hongkongensis* (PH03) in Area C under Contract 1 remained in satisfactory condition in December 2013.



Appendix M

Ecological Monitoring Report in Area under Contract 2 (Not Used)