# Civil Engineering and Development Department

EP-344/2009 – New Sewage Pumping Stations Serving KTD and EP-337/2009 – New Distributor Roads Serving the Planned KTD

# Contract No. KL/2012/03 Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area

Quarterly EM&A Summary Report

June 2015 - August 2015

(Version 1.0)

Approved By

(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties

#### CINOTECH CONSULTANTS LTD

Room 1710, Technology Park, 18 On Lai Street, Shatin, NT, Hong Kong Tel: (852) 2151 2083 Fax: (852) 3107 1388 Email: info@cinotech.com.hk

## TABLE OF CONTENTS

	Pa	age
	EXECUTIVE SUMMARY	1
	Introduction Environmental Monitoring Works Key Information in the Reporting Quarter	1
1.	INTRODUCTION	3
	Background Project Organizations	3 3
2.	ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS	5
	Monitoring Parameters and Monitoring Locations	5 5 5
3.	MONITORING RESULTS AND NON-COMPLIANCE (EXCEEDANCES) OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION ANI LIMIT LEVELS)	
	Weather Conditions  Air Quality  Construction Noise  Landscape and Visual  Influencing Factors on the Monitoring Results  Comparison of EM&A results with EIA predictions	6 7 7
4.	COMMENTS, CONCLUSIONS AND RECOMMENDATIONS	9
	Review of the Reasons for and the Implications of Non-compliance Effectiveness of Mitigation Measures	

## LIST OF TABLE

Table I	Summary Table for Non-compliance Recorded in the Reporting Quarter
Table II	Summary Table for Key Information in the Reporting Quarter
Table 1.1	Key Project Contacts
Table 3.1	Summary of Weather Conditions in the Reporting Period
Table 3.2	Major Dust Sources during the Monitoring in the Reporting Period
Table 3.3	Major Noise Sources during the Monitoring in the Reporting Period

#### LIST OF FIGURES

Figure 1	Layout Plan of the Project
Figure 2	Locations of Air Quality Monitoring Stations
Figure 3	Locations of Construction Noise Monitoring Stations

# LIST OF APPENDICES

A	Monitoring Requirements
В	Action and Limit Levels for Air Quality and Noise
C	Graphical Presentation of Air Quality Monitoring Results
D	Graphical Presentation of Noise Monitoring Results
E	Environmental Mitigation Implementation Schedule (EMIS)
F	Site Audit Summary
G	Waste Generated Quantity
H	Summary of Exceedances

#### LIST OF ANNEXES

Annex I Comparison of EM&A Data and EIA Predictions

#### **EXECUTIVE SUMMARY**

#### Introduction

1. This is the 7<sup>th</sup> Quarterly Environmental Monitoring and Audit Report prepared by Cinotech Consultants Ltd. for "Contract No. KL/2012/03 - Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area" (Hereafter referred to as "the Project"). This summary report presents the EM&A works performed in the period between June 2015 and August 2015.

#### **Environmental Monitoring Works**

- 2. Environmental monitoring for the Project was performed in accordance with the EM&A Manual and the monitoring results were checked and reviewed. Site Inspections/Audits were conducted once per week. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
- 3. Summary of the non-compliance in the reporting quarter for the Project is tabulated in Table I.

Table I Non-compliance Record for the Project in the Reporting Quarter

Domomoton	No. of Exc	Action	
Parameter —	Action Level	Limit Level	Taken
June 2015			
1-hr TSP	0	0	N/A
24-hr TSP	0	0	N/A
Noise	0	0	N/A
July 2015			
1-hr TSP	0	0	N/A
24-hr TSP	0	0	N/A
Noise	0	0	N/A
August 2015			
1-hr TSP	0	0	N/A
24-hr TSP	0	0	N/A
Noise	0	0	N/A

4. No exceedance was recorded at any air quality or noise monitoring station during the past 3 months.

## **Key Information in the Reporting Quarter**

5. Summary of key information in the reporting quarter is tabulated in Table II.

Table II Summary Table for Key Information in the Reporting Quarter

Б. 4			1 8 0		D 1
Event	Event Details		Action Taken	Status	Remark
	Number	Nature			
Complaint received	0		N/A	N/A	
Reporting Changes	0		N/A	N/A	
Notifications of any summons & prosecutions received	0		N/A	N/A	

6. Environmental monitoring works for the Project are considered effective and are generating data to categorically identify the environmental impacts from the works and influencing factors in the vicinity of monitoring stations.

#### 1. INTRODUCTION

#### **Background**

- 1.1 The Kai Tak Development (KTD) is located in the south-eastern part of Kowloon Peninsula, comprising the apron and runway areas of the former Kai Tak Airport and existing waterfront areas at To Kwa Wan, Ma Tau Kok, Kowloon Bay, Kwun Tong and Cha Kwo Ling. It covers a land area of about 328 hectares. Stage 4 Infrastructure at Former North Apron Area is one of the construction stages of KTD. The general layout of the Project is shown in **Figure 1.**
- 1.2 The construction activities undertaken in the reporting quarter were:
  - Daily Clearance;
  - Base slab, wall, roof construction of Box culvert B5;
  - Backfilling of box culvert B5
  - Excavation of trench for sewers;
  - Excavation for NPS for Portion 4 and Box culvert B6;
  - Strut and waling of NPS;
  - Installation of DN750 drainage pipe and sewer at L19;
  - Installation of precast box culvert B6;
  - Installation of DCS;
  - Fixing of reinforcement and concreting to walls and slab of pumping station for PS2;
  - Laying concrete pipes DN750 from FMH10 345 to FHH10 350;
  - Construction of jacking pits 10, 11, 3 & 4; and
  - Widening works of Sung Wong Toi Road.
- 1.3 Cinotech Consultants Limited (Cinotech) was commissioned by Kwan On Construction Co., Ltd. (the Contractor) to undertake the role of the Environmental Team (ET) for the Contract No. KL/2012/03 Stage 4 Infrastructure at Former North Apron Area. The construction work under KL/2012/03 comprises the construction of Road D2 & Sewage Pumping Station PS2 and PS NPS which forms a part of the works under two EPs (EP-337/2009 and EP-344/2009).
- 1.4 The construction commencement of this Contract was on 1<sup>st</sup> December 2013 for Road D2, Sewage Pumping Station PS2 and PS NPS. This summary report presents the EM&A works performed in the period between June 2015 and August 2015.

#### **Project Organizations**

- 1.5 Different parties with different levels of involvement in the project organization include:
  - Project Proponent Civil Engineering and Development Department (CEDD).
  - The Engineer and the Engineer's Representative (ER) AECOM.
  - Environmental Team (ET) Cinotech Consultants Limited (CCL).
  - Independent Environmental Checker (IEC) Hyder Consultants Ltd. (Hyder).
  - Contractor –Kwan On Construction Co., Ltd. (Kwan On).
- 1.6 The key contacts of the Project are shown in **Table 1.1**.

#### Table 1.1 Key Project Contacts

Party	Role	Contact Person	Position	Phone No.	Fax No.
CEDD	Project Proponent	Mr. K Y SHIN	Engineer	2301 1461	2301 1277
AECOM	Engineer's	Mr. Vincent Lee	SRE	2798 0771	3013 8864
AECOM	Representative	Mr. Mickey Lee	RE		
		Dr. Priscilla Choy	Environmental	2151 2089	
	Environmental Team		Team Leader	2131 2009	
Cinotech		Ms. Ivy Tam	Project Coordinator		3107 1388
			and Audit Team	2151 2090	
			Leader		
	Independent	Mr. Wong Fu Nam	Independent		
Hyder	Environmental		Environmental	2911 2744	2805 5028
	Checker		Checker		
	Contractor	Mr. Terry Yu	Site Agent	3689 7752	3689 7726
Kwan On				6146 676	l (Hotline
				telephone nun	nber)

### 2. ENVIRONMENTAL MONITORING AND AUDIT REQUIREMENTS

#### **Monitoring Parameters and Monitoring Locations**

2.1 The EM&A Manual designates locations for the ET to monitor environmental impacts in terms of air quality, noise, landscape and visual due to the Project. The Project area and monitoring locations are depicted in **Figures 2 and 3**. **Appendix A** gives details of monitoring requirements.

#### **Environmental Quality Performance Limits (Action and Limit Levels)**

2.2 The environmental quality performance limits, i.e. Action and Limit Levels were derived from the baseline monitoring results. Should the measured environmental quality parameters exceed the Action/Limit Levels, the respective action plans would be implemented. The Action/Limit Levels for each environmental parameter are given in **Appendix B**.

#### **Implementation Status of Environmental Mitigation Measures**

2.3 Relevant mitigation measures as recommended in the project EIA report have been stipulated in the EM&A Manual for the Contractor to implement. The implementation status of environmental mitigation measures (EMIS) is given in **Appendix E**.

#### **Site Audit Summary**

2.4 During site inspections in the reporting period, no non-conformance was identified. The observations and recommendations made during the reporting period are summarized in **Appendix F**.

#### **Status of Waste Management**

2.5 The amount of wastes generated by the major site activities of this Project during the reporting quarter is shown in **Appendix G**.

# 3. MONITORING RESULTS AND NON-COMPLIANCE (EXCEEDANCES) OF THE ENVIRONMENTAL QUALITY PERFORMANCE LIMITS (ACTION AND LIMIT LEVELS)

3.1 Environmental monitoring works were performed in the reporting period and all monitoring results were checked and reviewed. A summary of exceedances is attached in **Appendix H**.

#### **Weather Conditions**

3.2 The weather during monitoring sessions was summarized in Table 3.1.

Table 3.1 Summary of Weather Conditions in the Reporting Period

Reporting Month	General Weather Conditions
June 2015	Cloudy and Sunny
July 2015	Cloudy and Rainy
August 2015	Fine and Sunny

3.3 The detail of weather conditions for each individual monitoring session was presented in monthly EM&A report.

#### Air Quality

#### 1-hour TSP Monitoring

- 3.4 1-hour TSP monitoring at Station AM2 Lee Kau Yan Memorial School and Station AM5(A) Po Leung Kuk Ngan Po Ling College on 22 July 2015 was unsuccessful due to heavy rain. The monitoring works were rescheduled and carried out on 23 July 2015.
- 3.5 Other 1-hour TSP monitoring was conducted as scheduled in the reporting quarter. No Action/Limit Level exceedance was recorded for 1-hr TSP monitoring in the reporting quarter.

#### 24-hour TSP Monitoring

- 3.6 24-hour TSP monitoring at Station AM5(A) Po Leung Kuk Ngan Po Ling College on 24 August 2015 was cancelled due to the internal electrical works of the school.
- 3.7 Other 24-hour TSP monitoring was conducted as scheduled in the reporting quarter. No Action/Limit Level exceedance was recorded for 24-hr TSP monitoring in the reporting quarter.
- 3.8 The graphical presentations of the air quality monitoring results are shown in **Appendix C**.

#### **Construction Noise**

- 3.9 Noise monitoring at Station M8 Po Leung Kuk Ngan Po Ling College on 22 July 2015 was unsuccessful due to heavy rain. The monitoring works were rescheduled and carried out on 23 July 2015.
- 3.10 Noise monitoring at Station M8 Po Leung Kuk Ngan Po Ling College on 28 July 2015 was considered invalid due to breaking works inside the school. The monitoring works were rescheduled and carried out on 30 July 2015.
- 3.11 Other construction noise monitoring was conducted as scheduled in the reporting quarter. No Action and Limit Level exceedance was recorded for noise monitoring in the reporting quarter.
- 3.12 The graphical presentations of the noise monitoring results are shown in **Appendix D**.

#### Landscape and Visual

3.13 Site audits were carried out on a weekly basis to monitor and audit the timely implementation of landscape and visual mitigation measures of this project. No non-compliance of the landscape and visual impact was recorded in the reporting quarter.

#### **Influencing Factors on the Monitoring Results**

3.14 During the reporting period, the major dust and noise sources identified at the designated monitoring stations are as follows:

 Table 3.2
 Major Dust Sources in the Reporting Period

Station	Major Dust Source
AM2 – Lee Kau Yan Memorial School	Road Traffic Dust
	Exposed site area and open stockpiles
	Site vehicle movement
AM3(A) – Holy Trinity Bradbury	Road Traffic Dust
Centre	Exposed site area
	Excavation works
	Site vehicle movement
AM4(A) – EMSD Workshops	Site vehicle movement
AM5(A) – Po Leung Kuk Ngan Po	Road Traffic Dust
Ling College	Excavation works at the site (Contract No.:
	1/WSD/08(K)) facing Po Leung Kuk Ngan Po
	Ling College

Table 3.3 Major Noise Sources during the Monitoring in the Reporting Period

Monitoring Stations	Locations	Major Noise Source	
M6	Holy Carpenter Primary School	Road and marine traffic Noise	
M6(A) Oblate Primary School		Road and marine traffic Noise	
M7 CCC Kei To Secondary School		Road and marine traffic Noise	
M8	Po Leung Kuk Ngan Po Ling College	Excavation works at the site (Contract No.: 1/WSD/14(K)) facing Po Leung Kuk Ngan Po Ling College	
M9	Tak Long Estate	Road paving and asphalt paving works	

#### Comparison of EM&A results with EIA predictions

- 3.15 According to Section 16.7.1 (viii) of the EM&A Manual, the EM&A data are compared with the EIA predictions and summarized in **Annex I**.
- 3.16 The 1-hour and 24-hour average TSP concentrations in the reporting period were generally well below the prediction in the approved Environmental Impact Assessment (EIA) Report. No Action/Limit Level exceedance was recorded.
- 3.17 The noise monitoring results in the reporting month were within the range of predicted mitigated construction noise levels in the EIA report. No Action/Limit Level exceedance was recorded.

#### 4. COMMENTS, CONCLUSIONS AND RECOMMENDATIONS


#### Review of the Reasons for and the Implications of Non-compliance


4.1 No Action/Limit Level exceedance was recorded at all air quality and noise monitoring stations in the reporting quarter.


#### **Effectiveness of Mitigation Measures**


- 4.2 The mitigation measures recommended in the EIA report are considered effective in minimizing environmental impacts.
- 4.3 The Contractor has implemented the recommended mitigation measures except those mitigation measures not applicable at this stage.
- 4.4 Environmental monitoring works performed in the reporting quarter and all monitoring results were checked and reviewed. No non-compliance (exceedances) of Action/Limit Level was recorded.
- 4.5 No environmental complaints and environmental prosecution were received in the reporting quarter.
- 4.6 The effectiveness of environmental management is satisfactory given that the recommendations given in the site inspections performed in the reporting period (as shown in **Appendix F**) are met.


# **FIGURES**

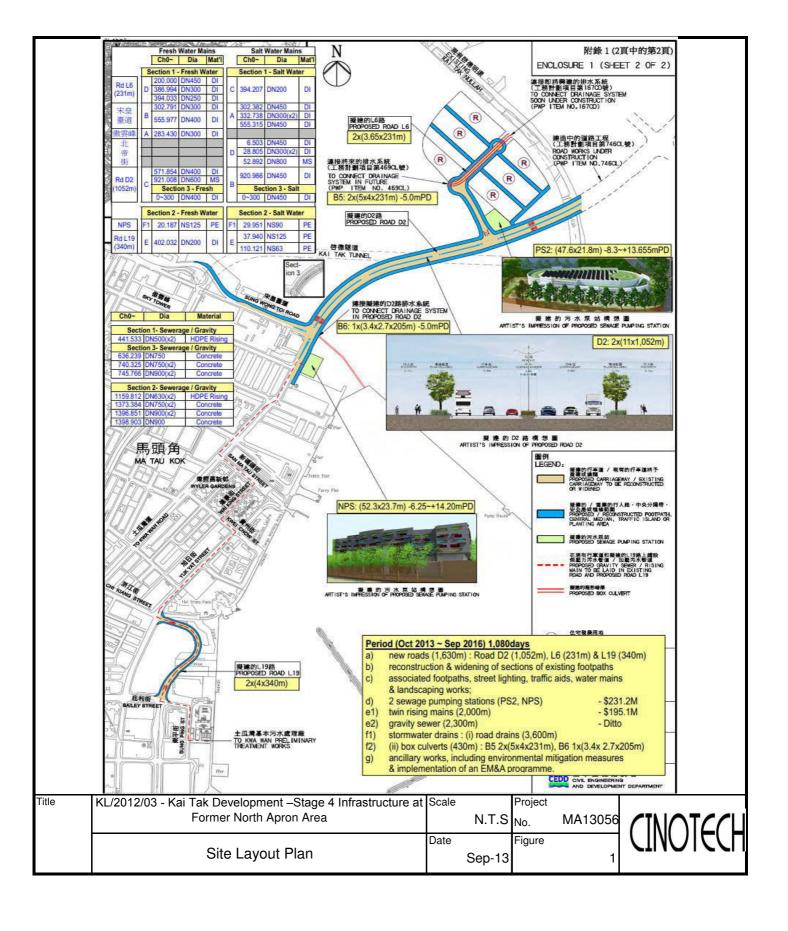

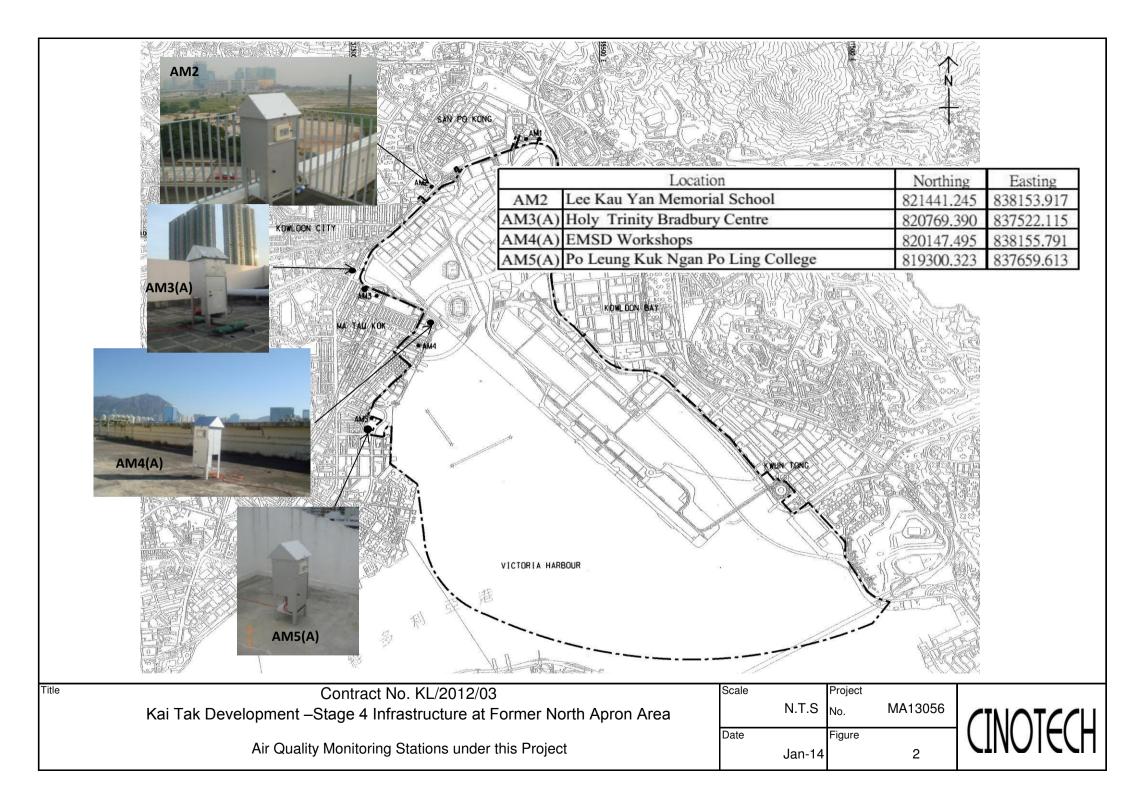

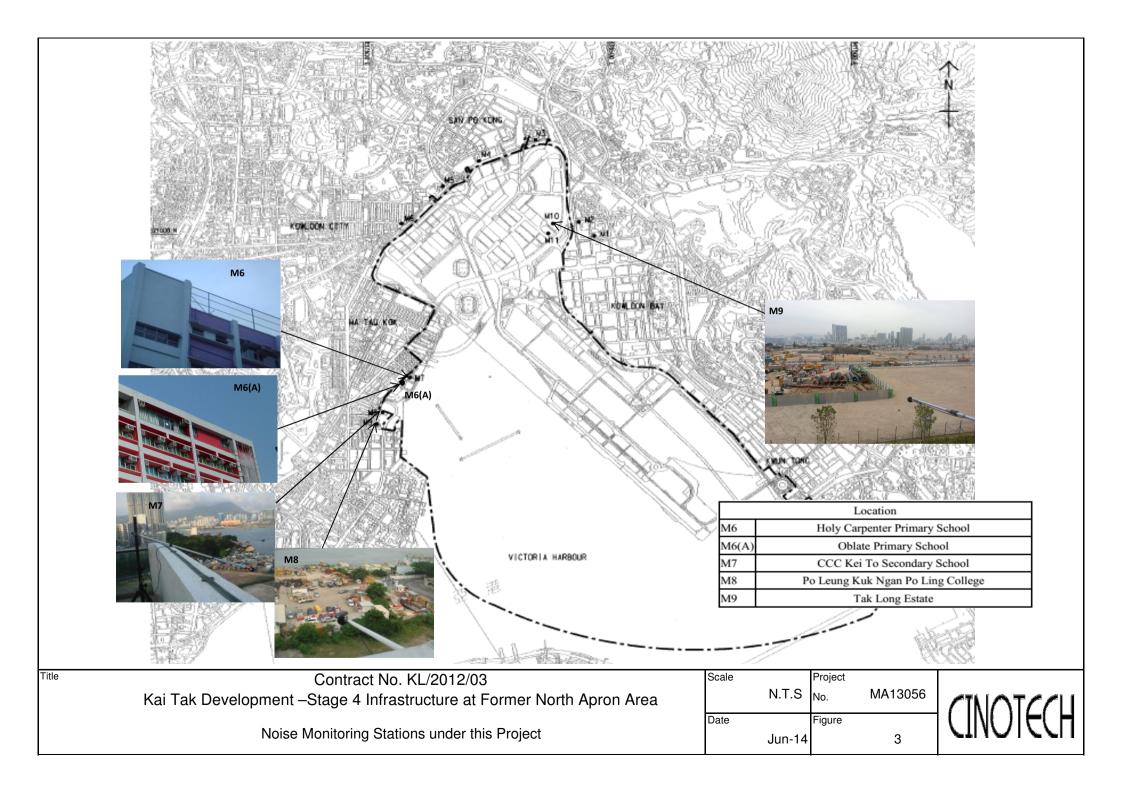

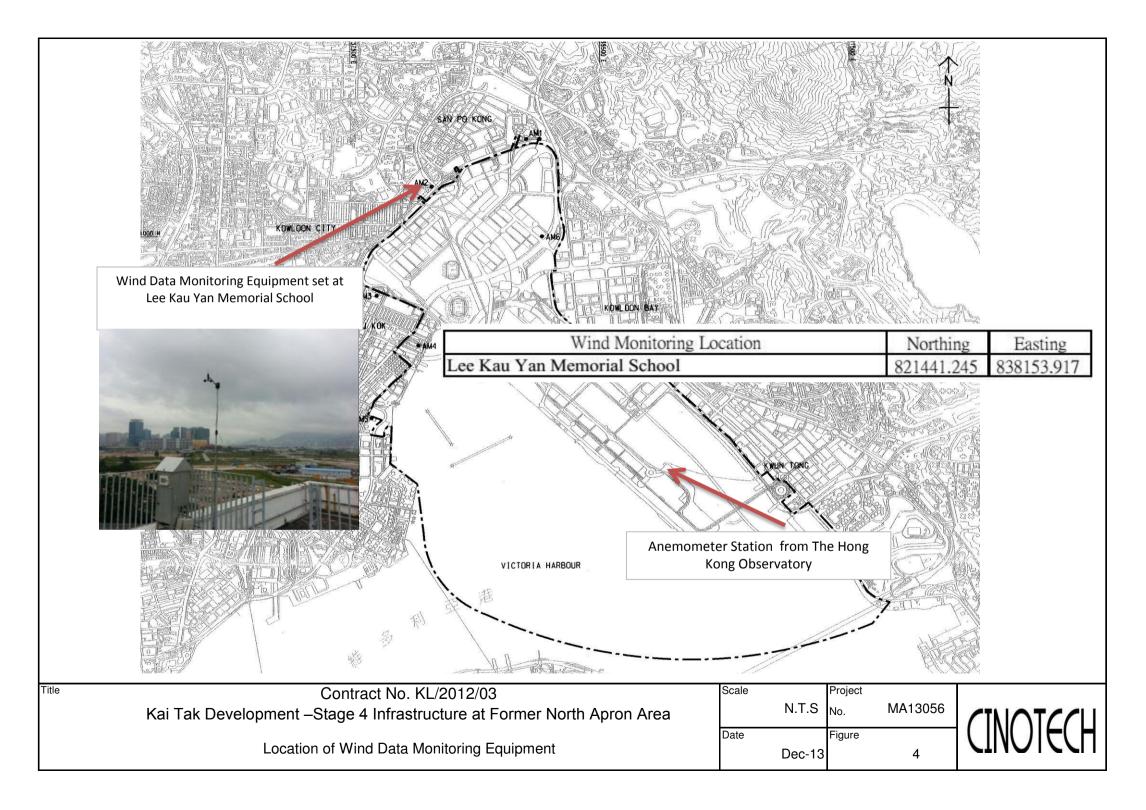

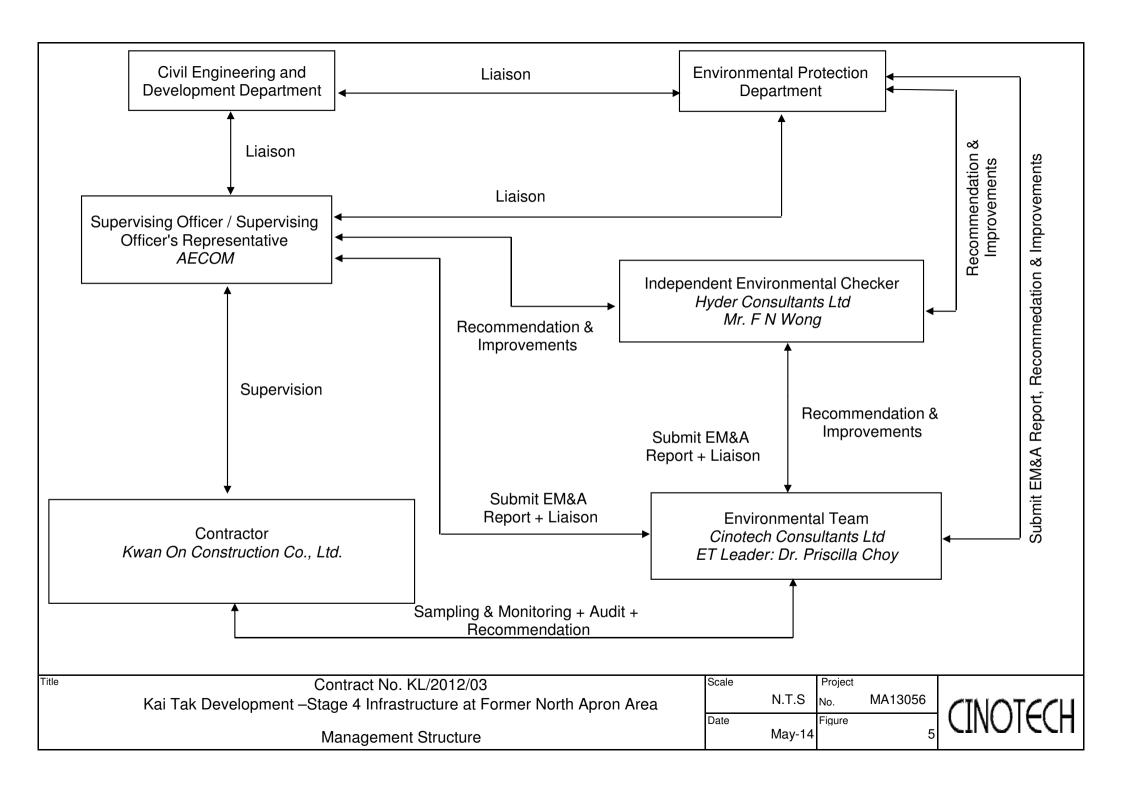

# APPENDIX A MONITORING REQUIREMENTS

Appendix A - Environmental Impact Monitoring Requirements

Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
	1 hour TSP	Three times / 6 days		
Air Quality	24 hour TSP	Once / 6 days	<ul> <li>AM2 – Lee Kau Yan Memorial School</li> <li>AM3(A) – Holy Trinity Bradbury Centre</li> <li>AM4(A) – EMSD Workshop</li> <li>AM5(A) – Po Leung Kuk Ngan Po Ling College</li> <li>#AM6 – PA 15</li> </ul>	<ul> <li>AM2 – Rooftop (about 8/F) Area</li> <li>AM3(A) - Rooftop (about 8/F) Area</li> <li>AM4(A) - Rooftop (about 6/F) Area</li> <li>AM5(A) - Rooftop (about 10/F) Area</li> <li>#AM6 – Site 1B4 (Planned)</li> </ul>

Remarks: # The impact monitoring at these locations will only be carried out until existence of the sensitive receiver at the building.

Type of Monitoring	Parameter	Frequency	Location	Measurement Conditions
Construction Noise	L <sub>eq</sub> , L <sub>90</sub> & L <sub>10</sub> at 30 minute intervals during (0700 to 1900 on normal weekdays)	Once per week	<ul> <li>M6 – Holy Carpenter Primary School</li> <li>M6(A) - Oblate Primary School</li> <li>M7 – CCC Kei To Secondary School</li> <li>M8 – Po Leung Kuk Ngan Po Ling College</li> <li>M9 – Tak Long Estate (from April 2014 onward)</li> <li>#M10 (Site 1B4 (Planned))</li> </ul>	<ul> <li>M6 - Facade measurement at Rooftop (about 7/F) Area</li> <li>M6(A) – Free-field measurement at Rooftop (about 7/F) Area</li> <li>M7 - Facade measurement at Rooftop (about 8/F) Area</li> <li>M8 - Facade measurement at Staircase Area (about 9/F)</li> <li>M9 – Façade measurement at 2/F Podium</li> <li>#M10 (Site 1B4 (Planned))</li> </ul>

Remarks: # The impact monitoring at these locations will only be carried out until existence of the sensitive receiver at the building.

APPENDIX B ACTION AND LIMIT LEVELS FOR AIR QUALITY AND NOISE

# Appendix B - Action and Limit Levels

Table B-1 Action and Limit Levels for 1-Hour TSP

Location	Action Level, μg/m³	Limit Level, μg/m³
AM2	346	
AM3(A)	351	500
AM4(A)	371	500
AM5(A)	345	

Table B-2 Action and Limit Levels for 24-Hour TSP

Location	Action Level, μg/m³	Limit Level, μg/m³
AM2	157	
AM3(A)	167	260
AM4(A)	187	260
AM5(A)	156	


**Table B-3** Action and Limit Levels for Construction Noise


Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A) 70dB(A)/65dB(A)*

Remarks: If works are to be carried out during restricted hours, the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority have to be followed. \*70dB(A) and 65dB(A) for schools during normal teaching periods and school examination periods, respectively.

APPENDIX C GRAPHICAL PRESENTATION OF AIR QUALITY MONITORING RESULTS


#### 1-hr TSP Concentration Levels

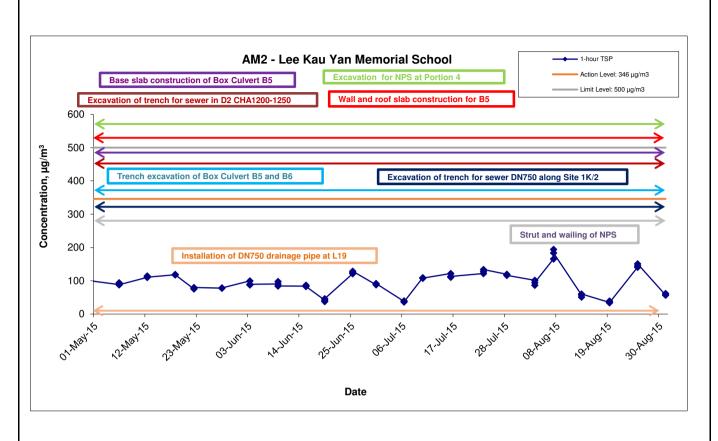


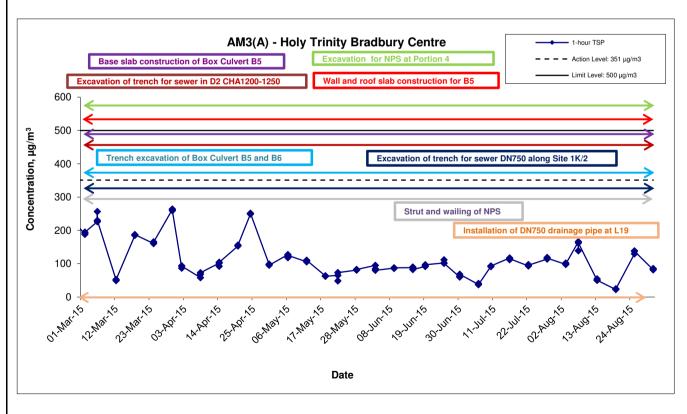

Title	Contract No. KL/2012/03 Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area	Scale		Project No. MA13	3056	CINOTECH
	Graphical Presentation of 1-hour TSP Monitoring Results	Date	Aug 15	Appendix E	Ξ	CINOICCI

#### 1-hr TSP Concentration Levels

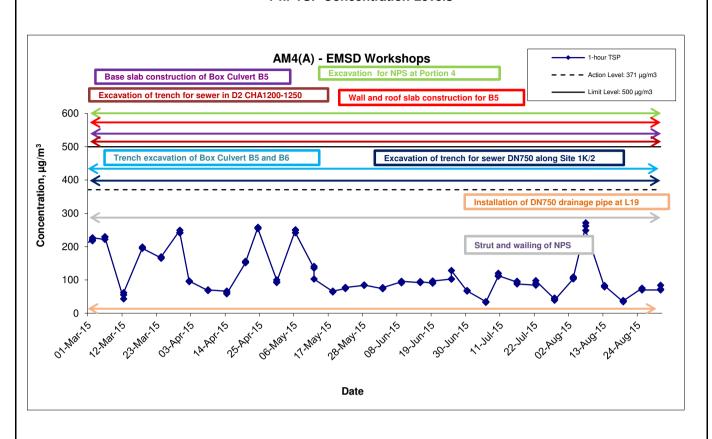

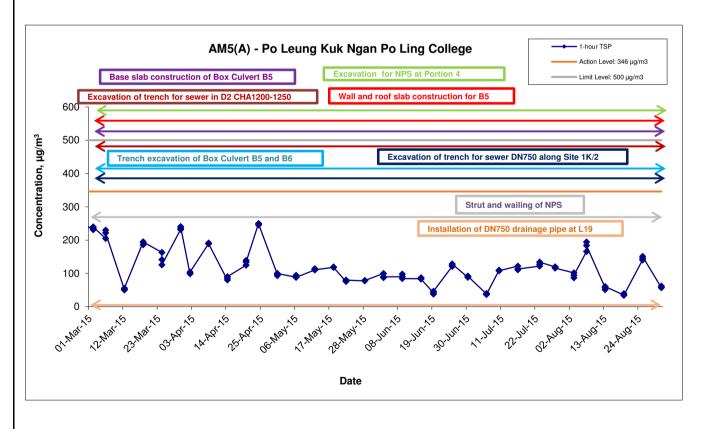

Title Contract No. KL/2012/03
Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area


Graphical Presentation of 1-hour TSP Monitoring Results


Scale Project
No. MA13056

Date Aug 15

Appendix

E

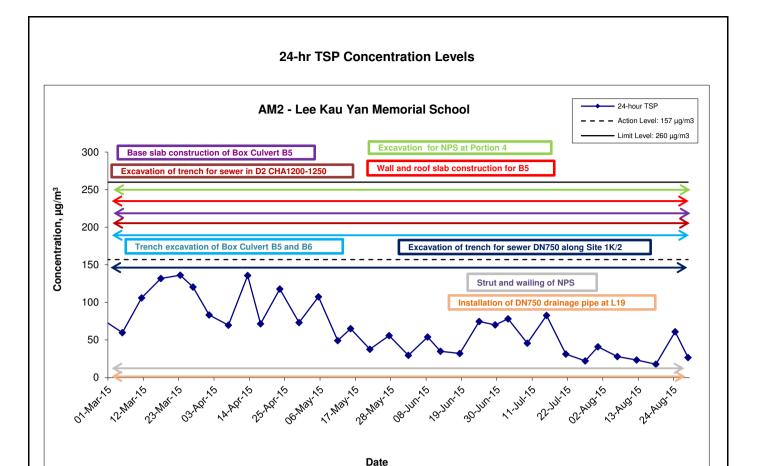

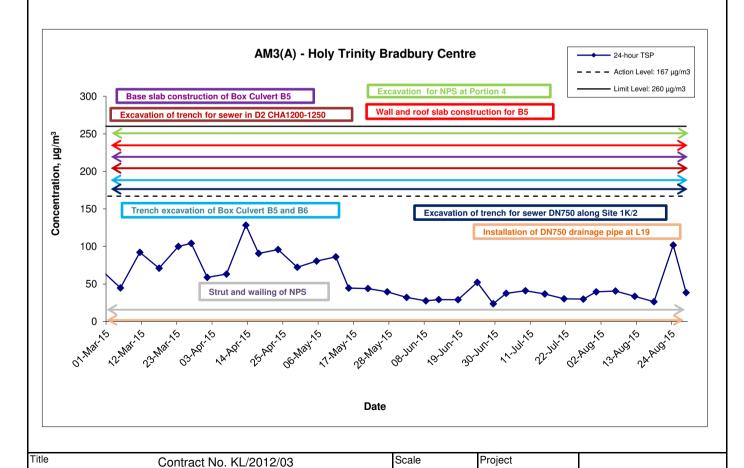

Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area

Graphical Presentation of 24-hour TSP Monitoring Results

N.T.S

Aug 15


Date


No.

Appendix

MA13056

F

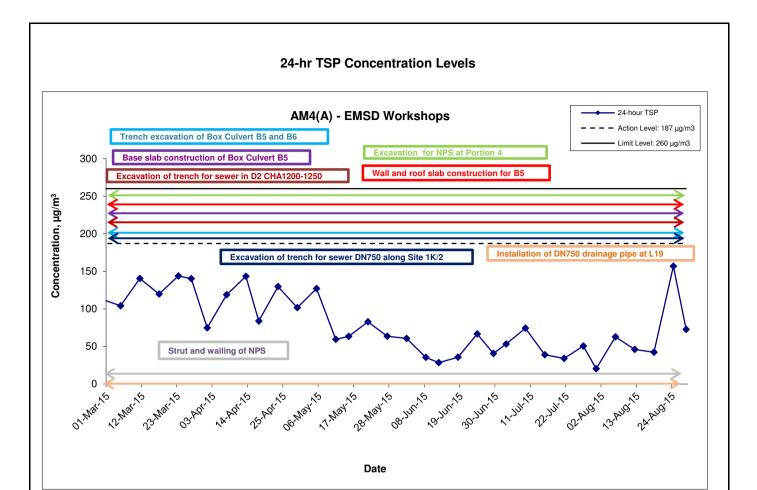

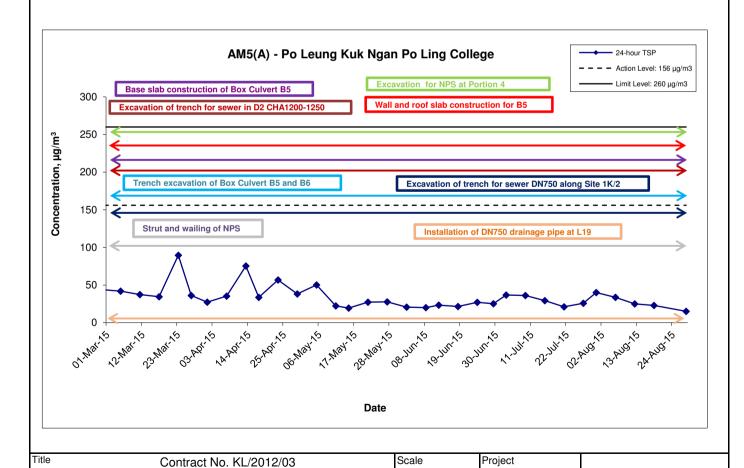

Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area

Graphical Presentation of 24-hour TSP Monitoring Results

No.

Appendix

N.T.S

Aug 15


Date


MA13056

F

#### APPENDIX D GRAPHICAL PRESENTATION OF NOISE MONITORING RESULTS


#### **Noise Levels**

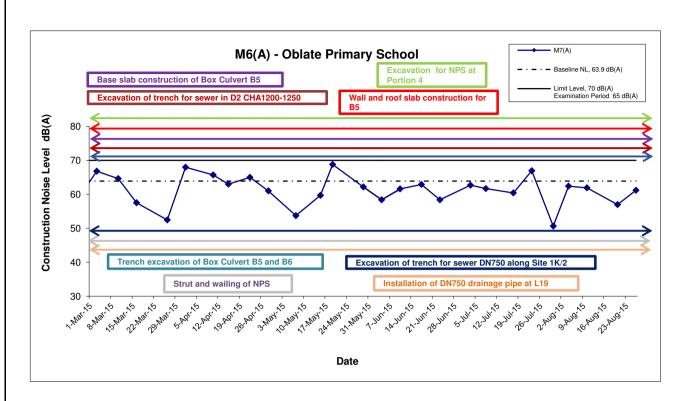


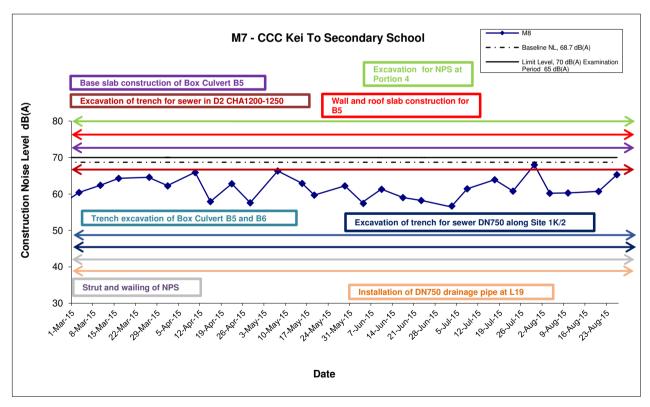

Remarks: The construction noise levels in the Tables in Appendix G were adopted for plotting the graphs

Т	itle Contract No. KL/2012/03 Kai Tak Development –Stage 4 Infrastructure at Former North Apron Area	Scale	N.T.S	Project No. MA13056	CINOTCCL
	Graphical Presentation of Construction Noise Monitoring Results	Date	Aug 15	Appendix G	CINOTECH

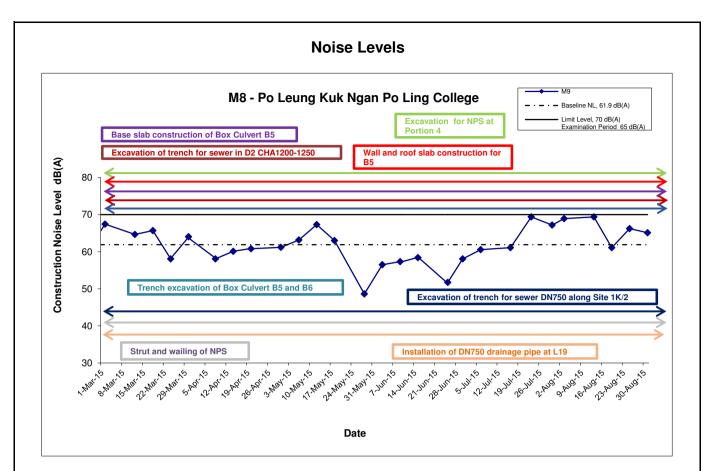

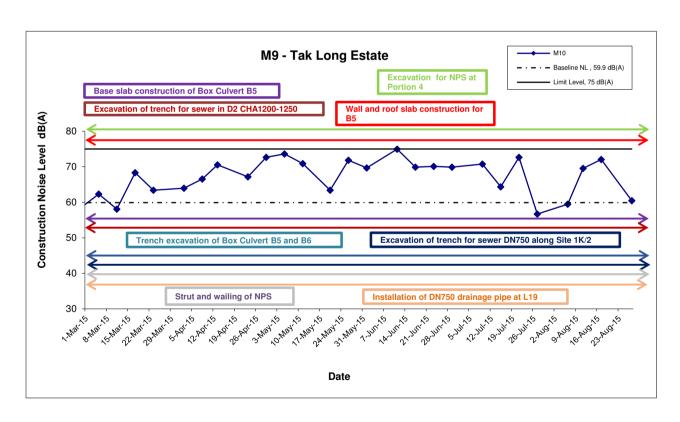

Remarks: The construction noise levels in the Tables in Appendix G were adopted for plotting the graphs

ŀ	Title Contract No. KL/2012/03  Kai Tak Development –Stage 4 Infrastructure at Former North Apron	Scale	Project No.	CINATCOLL
	Area	N.T.S	MA13056	1( 1N1( )1 <b>—</b> ( <b>H</b>
	Graphical Presentation of Construction Noise Monitoring Results	Date Aug 15	Appendix G	CINOICCI

APPENDIX E ENVIRONMENTAL MITIGATION IMPLEMENTATION SCHEDULE (EMIS)

# Appendix E - Summary of Implementation Schedule of Mitigation Measures for Construction Phase

Mitigation Measures	Status
8 times daily watering of the work site with active dust emitting activities.  Implementation of dust suppression measures stipulated in Air Pollution Control (Construction Dust) Regulation. The following mitigation measures, good site practices and a comprehensive dust monitoring and audit programme are recommended to minimize cumulative dust impacts.  • Stockpiling site(s) should be lined with impermeable sheeting and bunded. Stockpiles should be fully covered by impermeable sheeting to reduce dust emission.  • Misting for the dusty material should be carried out before being loaded into the vehicle.  • Any vehicle with an open load carrying area should	*  *  *
<ul> <li>Material having the potential to create dust should not be loaded from a level higher than the side and tail boards and should be dampened and covered by a</li> </ul>	^
<ul> <li>The tarpaulin should be properly secured and should extent at least 300 mm over the edges of the sides and tailboards. The material should also be dampened if necessary before transportation.</li> </ul>	٨
of 10 km per hour and confined haulage and delivery vehicle to designated roadways insider the site. On- site unpaved roads should be compacted and kept free	۸
<ul> <li>Vehicle washing facilities should be provided at every vehicle exit point.</li> </ul>	^
section of the road between the washing facilities and the exit point should be paved with concrete,	٨
<ul> <li>Every main haul road should be scaled with concrete and kept clear of dusty materials or sprayed with water so as to maintain the entire road surface wet.</li> </ul>	*
covered entirely by impervious sheeting placed in an area sheltered on the top and the three sides.	^
Every vehicle should be washed to remove any dusty materials from its body and wheels before leaving the construction sites.	^
	8 times daily watering of the work site with active dust emitting activities.  Implementation of dust suppression measures stipulated in Air Pollution Control (Construction Dust) Regulation. The following mitigation measures, good site practices and a comprehensive dust monitoring and audit programme are recommended to minimize cumulative dust impacts.  • Stockpiling site(s) should be lined with impermeable sheeting and bunded. Stockpiles should be fully covered by impermeable sheeting to reduce dust emission.  • Misting for the dusty material should be carried out before being loaded into the vehicle.  • Any vehicle with an open load carrying area should have properly fitted side and tail boards.  • Material having the potential to create dust should not be loaded from a level higher than the side and tail boards and should be dampened and covered by a clean tarpaulin.  • The tarpaulin should be properly secured and should extent at least 300 mm over the edges of the sides and tailboards. The material should also be dampened if necessary before transportation.  • The vehicles should be restricted to maximum speed of 10 km per hour and confined haulage and delivery vehicle to designated roadways insider the site. Onsite unpaved roads should be compacted and kept free of lose materials.  • Vehicle washing facilities should be provided at every vehicle exit point.  • The area where vehicle washing takes place and the section of the road between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores.  • Every main haul road should be scaled with concrete and kept clear of dusty materials or sprayed with water so as to maintain the entire road surface wet.  • Every stock of more than 20 bags of cement should be covered entirely by impervious sheeting placed in an area sheltered on the top and the three sides.  • Every vehicle should be washed to remove any dusty materials from its body and wheels before leaving the

	Use of quiet PME, movable barriers barrier for Asphalt Paver, Breaker, Excavator and Hand-held breaker and full enclosure for Air Compressor, Bar Bender, Concrete Pump, Generator and Water Pump	۸
Construction Noise	<ul> <li>Good Site Practice:</li> <li>Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program.</li> <li>Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program.</li> <li>Mobile plant, if any, should be sited as far away from NSRs as possible.</li> <li>Machines and plant (such as trucks) that may be in intermittent use should be shut down between works periods or should be throttled down to a minimum.</li> <li>Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs.</li> <li>Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities.</li> <li>Scheduling of Construction Works during School Examination Period</li> <li>(i) Provision of low noise surfacing in a section of Road L2; and</li> </ul>	^ N/A(1)  ^ ^  ^  ^  N/A
Noise	(ii) Provision of structural fins	NI/A
	(i) Avoid the sensitive façade of class room facing Road L2 and L4; and	N/A N/A
	(ii) Provision of low noise surfacing in a section of Road L2 & L4	N/A
	(i) Provision of low noise surfacing in a section of Road L4 before occupation of Site 1I1; and	N/A
	(ii) Setback of building about 5m from site boundary.	N/A
	Setback of building about 35m to the northwest direction at 1L3 and 5m at Site 1L2.	N/A
	<ul> <li>avoid any sensitive façades with openable window facing the existing Kowloon City Road network;</li> </ul>	N/A
	and  for the sensitive facades facing the To Kwa Wan direction, either setback the facades by about 5m to the northeast direction or do not provide the facades with openable window.	N/A

	avoid any sensitive facades with openable window facing the existing To Kwa Wan Road or provision of 17.5m high noise tolerant building fronting To Kwa Wan Road and restrict the height of the residential block(s) located at less than 55m away from To Kwa Wan Road to no more than 25m above ground.	N/A N/A
	(i) avoid any sensitive facades with openable window facing the slip road connecting Prince Edward Road East and San Po Kong or other alternative mitigation measures and at-source mitigation measures for the surrounding new local roads to minimise the potential traffic noise impacts from the slip road	N/A
	All the ventilation fans installed in the below will be provided with silencers or acoustics treatment.  (i) SPS  (ii) ESS  (iii) Tunnel Ventilation Shaft  (iv) EFTS depot	N/A N/A N/A N/A
	Installation of retractable roof or other equivalent measures	N/A
	The following mitigation measures are proposed to be incorporated in the design of the SPS at KTD, including:	
	<ul> <li>Dual power supply or emergency generator should be provided at all the SPSs to secure electrical power supply;</li> </ul>	N/A
	Standby pumps should be provided at all SPSs to ensure smooth operation of the SPS during maintenance of the duty pumps;  An elementary should be installed to signal amargangulaid.	N/A
Construction Water	<ul> <li>An alarm should be installed to signal emergency high water level in the wet well at all SPSs; and</li> <li>For all unmanned SPSs, a remote monitor system connecting SPSs with the control station through telemetry system should be provided so that swift actions could be taken in case of malfunction of unmanned facilities.</li> </ul>	N/A N/A
Quality	Land-based Construction	
	Construction Runoff	
	Exposed soil areas should be minimised to reduce the potential for increased siltation, contamination of runoff, and erosion. Construction runoff related impacts associated with the above ground construction activities can be readily controlled through the use of appropriate mitigation measures which include:	٨
	use of sediment traps     adequate maintenance of drainage systems to prevent flooding and overflow	^ ^

Construction site should be provided with adequately designed perimeter channel and pre-treatment facilities and proper maintenance. The boundaries of critical areas of earthworks should be marked and surrounded by dykes or embankments for flood protection. Temporary ditches should be provided to facilitate runoff discharge into the appropriate watercourses, via a silt retention pond. Permanent drainage channels should incorporate sediment basins or traps and baffles to enhance deposition rates. The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94.

Ideally, construction works should be programmed to minimise surface excavation works during the rainy season (April to September). All exposed earth areas should be completed as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed slope surfaces should be covered by tarpaulin or other means.

Sediment tanks of sufficient capacity, constructed from pre-formed individual cells of approximately 6 to 8 m<sup>3</sup> capacity, are recommended as a general mitigation measure which can be used for settling surface runoff prior to disposal. The system capacity is flexible and able to handle multiple inputs from a variety of sources and particularly suited to applications where the influent is pumped.

Open stockpiles of construction materials (for examples, aggregates, sand and fill material) of more than 50 m<sup>3</sup> should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system.

Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers.

Precautions to be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecast, and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events.

Oil interceptors should be provided in the drainage system and regularly cleaned to prevent the release of oils and grease into the storm water drainage system after accidental spillages. The interceptor should have a bypass to prevent flushing during periods of heavy rain.

All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and located wheel washing bay should be provided at every site exit, and wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains.

#### Drainage

It is recommended that on-site drainage system should be installed prior to the commencement of other construction activities. Sediment traps should be installed in order to minimise the sediment loading of the effluent prior to discharge into foul sewers. There should be no direct discharge of effluent from the site into the sea.

All temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge should be adequately designed for the controlled release of storm flows. All sediment control measures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rain storms. The temporarily diverted drainage should be reinstated to its original condition when the construction work has finished or the temporary diversion is no longer required.

All fuel tanks and storage areas should be provided with locks and be located on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank, to prevent spilled fuel oils from reaching the coastal waters of the Victoria Harbour WCZ.

#### Sewage Effluent

Construction work force sewage discharges on site are expected to be connected to the existing trunk sewer or sewage treatment facilities. The construction sewage may need to be handled by portable chemical toilets prior to the commission of the on-site sewer system. Appropriate numbers of portable toilets should be provided by a licensed contractor to serve the large number of construction workers over the construction site. The Contractor should also be responsible for waste disposal and maintenance practices.

#### Stormwater Discharges

Minimum distances of 100 m should be maintained between the existing or planned stormwater discharges and the existing or planned seawater intakes

N/A

Λ

L	Debris and Litter	٨
v r	In order to maintain water quality in acceptable conditions with regard to aesthetic quality, contractors should be required, under conditions of contract, to ensure that site management is optimised and that disposal of any solid materials. litter or wastes to marine waters does not occur	X
	Construction Works at or in Close Proximity of Storm Culvert or Seafront	
w	The proposed works should preferably be carried out within the dry season where the flow in the drainage channel /storm culvert/ nullah is low.	۸
sp	The use of less or smaller construction plants may be pecified to reduce the disturbance to the bottom sediment at the drainage channel /storm culvert / nullah.	۸
m cc ar	emporary storage of materials (e.g. equipment, filling naterials, chemicals and fuel) and temporary stockpile of onstruction materials should be located well away from any water courses during carrying out of the construction works.	۸
sl	Stockpiling of construction materials and dusty materials should be covered and located away from any water courses.	۸
di	Construction debris and spoil should be covered up and/or lisposed of as soon as possible to avoid being washed into he nearby water receivers.	۸
w	Construction activities, which generate large amount of vastewater, should be carried out in a distance away from the waterfront, where practicable.	۸
ne m be	ditigation measures to control site runoff from entering the learby water environment should be implemented to minimize water quality impacts. Surface channels should be provided along the edge of the waterfront within the work sites to intercept the runoff.	۸
	Construction effluent, site run-off and sewage should be properly collected and/or treated.	۸
te c p	Any works site inside the storm water courses should be demporarily isolated, such as by placing of sandbags or silt curtains with lead edge at bottom and properly supported props to prevent adverse impact on the storm water quality.	۸
a	Silt curtain may be installed around the construction activities at the seafront to minimize the potential impacts due to accidental spillage of construction materials.	۸
S	Proper shoring may need to be erected in order to prevent soil/mud from slipping into the storm culvert/drainage channel/sea.	۸

	Supervisory staff should be assigned to station on site to closely supervise and monitor the works	۸
	Marine water quality monitoring and audit programme shall be implemented for the proposed sediment treatment operation.	۸
	It is not anticipated that adverse waste management related impacts would arise, provided that good site practices are adhered to. Recommendations for good site practices during construction activities include:  Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site  Training of site personnel in proper waste management and chemical waste handling procedures  Provision of sufficient waste disposal points and regular collection for disposal  Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers	^ ^
	<ul> <li>A recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites)</li> </ul>	۸
	Waste Reduction Measures Good management and control can prevent the generation of a significant amount of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste	
	Sort C&D waste from demolition of the remaining structures to recover recyclable portions such as metals	۸
	<ul> <li>Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal</li> </ul>	*
	Encourage collection of aluminium cans, PET bottles and paper by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the work force	۸
	<ul> <li>Any unused chemicals or those with remaining functional capacity should be recycled</li> <li>Proper storage and site practices to minimise the potential for damage or contamination of</li> </ul>	^
	construction materials	
1		İ

#### Construction and Demolition Material

Mitigation measures and good site practices should be incorporated into contract document to control potential environmental impact from handling and transportation of C&D material. The mitigation measures include:

- Where it is unavoidable to have transient stockpiles of C&D material within the Project work site pending collection for disposal, the transient stockpiles should be located away from waterfront or storm drains as far as possible
- Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric
- Skip hoist for material transport should be totally enclosed by impervious sheeting
- Every vehicle should be washed to remove any dusty materials from its body and wheels before leaving a construction site
- The area where vehicle washing takes place and the section of the road between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores
- The load of dusty materials carried by vehicle leaving a construction site should be covered entirely by clean impervious sheeting to ensure dust materials do not leak from the vehicle
- All dusty materials should be sprayed with water prior to any loading, unloading or transfer operation so as to maintain the dusty materials wet
- The height from which excavated materials are dropped should be controlled to a minimum practical height to limit fugitive dust generation from unloading

When delivering inert C&D material to public fill reception facilities, the material should consist entirely of inert construction waste and of size less than 250mm or other sizes as agreed with the Secretary of the Public Fill Committee. In order to monitor the disposal of the surplus C&D material at the designed public fill reception facility and to control fly tipping, a trip-ticket system as stipulated in the ETWB TCW No. 31/2004 "Trip Ticket System for Disposal of Construction and Demolition Materials" should be included as one of the contractual requirements and implemented by an Environmental Team undertaking the Environmental Monitoring and Audit work. An Independent Environmental Checker should be responsible for auditing the results of the system.

#### Chemical Waste

After use, chemical wastes (for example, cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Spent chemicals should be collected by a licensed collector for disposal at the CWTF or other licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation

E-8

	General Refuse	
	General refuse should be stored in enclosed bins or compaction units separate from C&D material. A licensed waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D material. Effective collection and storage methods (including enclosed and covered area) of site wastes would be required to prevent waste materials from being blown around by wind, wastewater discharge by flushing or leaching into the marine environment, or creating odour nuisance or pest and vermin problem	*
	CM1 All existing trees should be carefully protected during construction.	*
Landscape and Visual	CM2 Trees unavoidably affected by the works should be transplanted where practical. Detailed transplanting proposal will be submitted to relevant government departments for approval in accordance with ETWBC 2/2004 and 3/2006. Final locations of transplanted trees should be agreed prior to commencement of the work.	N/A
	CM3 Control of night-time lighting.	^
	CM4 Erection of decorative screen hoarding.	^

Remarks:	^ Compliance of mitigation measure;
	X Non-compliance of mitigation measure;
	N/A Not Applicable at this stage;
	N/A(1) Not observed;
	Non-compliance but rectified by the contractor;
	* Recommendation was made during site audit but improved/rectified by the contractor.

### APPENDIX F SITE AUDIT SUMMARY

## Appendix F Summary of Observation and Recommendation Made during Site Inspection

## Summary of Observation and Recommendation Made during Site Inspection in June 2015

Observations and Recommendations of Site Inspections for EP-337/2009

Parameters	Date	Observations and Recommendations	Follow-up
Water Quality	26 June 2015	To properly provide wheel washing for vehicles leaving Gate D and remove dusty trails.	Gate D was locked. The dusty trails was not observed.
Air Quality	26 June 2015	To properly provide wheel washing for vehicles leaving Gate D and remove dusty trails.	Gate D was locked. The dusty trails was not observed.
Noise			
Waste/Chemical Management	26 June 2015	To clear stand water accumulated in drip trays and construction materials.	The stand water accumulated was cleared.
Landscape and Visual			
Permits /Licences			

## Observations and Recommendations of Site Inspections for EP-344/2009

Parameters	Date	Observations and Recommendations	Follow-up
Water Quality			
Air Quality			
Noise			
Waste/Chemical Management	26 June 2015	To properly clear the C&D material and general rubbish accumulated. (Near NPS)	The C&D material and general rubbish were cleared.
Landscape and Visual			
Permits /Licences			

# Summary of Observation and Recommendation Made during Site Inspection in July 2015

Observations and Recommendations of Site Inspections for EP-337/2009

Parameters	Date	Observations and Recommendations	Follow-up		
	3 July 2015	Ensure site vehicles pass through the wheel washing bay before leaving, and maintain the wheel washing bay.	Vehicles were observed using the wheel washing facility.		
Water Quality	10 July 2015	Ponding of rainwater was observed near DCS. The Contractor was reminded to provide water pump to direct stand water to treatment facilities.	Stand water was observed cleared.		
	3 July 2015	Ensure site vehicles pass through the wheel washing bay before leaving, and maintain the wheel washing bay.	Vehicles were observed using the wheel washing facility.		
	3 July 2015	Regularly provide sufficient watering to the haul road.	Haul road was observed wet.		
Air Quality	15 July 2015	Dust emission was observed at major haul roads. The Contractor was reminded to provide water spray to haul roads more frequently.	The haul road was observed wet.		
	31 July 2015	Water spraying should be provided more frequently for haul road near PS2.	The haul road was observed wet.		
Noise					
Waste/Chemical Management					
Landscape and Visual					
Permits /Licences	-		1		

Observations and Recommendations of Site Inspections for EP-344/2009

Parameters	Date	Observations and Recommendations	Follow-up
Water Quality			
Air Quality			
Noise			
Waste/Chemical Management			
Landscape and Visual			-
Permits /Licences			

## Summary of Observation and Recommendation Made during Site Inspection in August 2015

**Observations and Recommendations of Site Inspections for EP-337/2009** 

Parameters	Date	Observations and Recommendations	Follow-up
Water Quality			
1 in On alita	7 August 2015	Water spraying should be provided more frequently for haul road near PS2.	The haul road was observed wet.
Air Quality	7 August 2015	Stockpile of dusty material should be covered properly.	Stockpile was observed covered.
Noise			
	7 August 2015	General refuse and construction waste should be cleared to avoid accumulation.	Waste was observed cleared.
Waste/Chemical	14 August 2015	General refuse and construction waste should be cleared to avoid accumulation.	Waste was observed cleared.
Management	19 August 2015	General refuse and construction waste was observed to accumulate near PS2. The contractor was reminded to provide sorting and adequate receptacles for the waste and dispose it properly.	Waste was observed cleared.
Landscape and Visual			
Permits /Licences			

Observations and Recommendations of Site Inspections for EP-344/2009

Paramet ers	Date	Observations and Recommendations	Follow-up
Water Quality			
Air Quality			
Noise			
Waste/Chemical Management			
Landscape and Visual			
Permits /Licences			

### APPENDIX G WASTE GENERATED QUANTITY

### APPENDIX IV

#### **Monthly Summary Waste Flow Table**

(PS Clause 1.86)

Name of Department: CEDD Contract No. : <u>KL/2012/03</u>

### Monthly Summary Waste Flow Table for August 2015 (year) (in tons)

			Actual Quan	Actual Quantities of Inert C&D Materials Generated Monthly Actual Quantities of C&D						of C&D Wastes	&D Wastes Generated Monthly		
Month	Total Disposal Loads	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemicals Waste	Others, e.g.	
	(No.s)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	(in tons)	
2013 (Oct – Dec) Sub-Total	108	463.69	0	0	0	0	0	0	0	0	0	463.69	
2014 (Jan – Dec) Sub-Total	24	16925.7	0	0	16798.93	83.66	1804.27	0	0	0	0	43.11	
Jan 2015	3	38301.47	0	0	38291.91	0	2064	0	0	0	0	9.56	
Feb 2015	2	7.8	0	0	0	0	1776	0	0	0	0	7.8	
Mar 2015	7	21.46	0	0	0	0	2450	0	0	0	0	21.46	
Apr 2015	26	2041.48	0	0	0	2230.43	2610	0	0	0	0	10.46	
May 2015	71	647.2	0	0	0	640.58	1550	0	0	0	0	6.62	
Jun 2015	60	516.9	0	0	0	501.45	0	0	0	0	0	15.45	
Jul 2015	9	27.74	0	0	0	0	0	0	0	0	0	27.74	
Aug 2015	12	45.39	0	0	0	0	0	0	0	0	0	45.39	
Total	310	58998.83	0	0	55090.84	3456.12	12254.27	0	0	0	0	651.28	

AECOM Asia Co. Ltd. PSA1AA/1 223 2015

### APPENDIX H SUMMARY OF EXCEEDANCES

## Contract No. KL/2012/03 Kai Tak Development - Stage 4 Infrastructure at Former North Apron Area

## **Appendix H – Summary of Exceedance**

Exceedance Report for Contract No. KL/2012/03

- (A) Exceedance Report for Air Quality (NIL in the reporting period)
- (B) Exceedance Report for Construction Noise (NIL in the reporting period)
- (C) Exceedance Report for Landscape and Visual (NIL in the reporting period)

ANNEX I COMPARISON OF EM&A DATA AND EIA PREDICTIONS

# **Annex I – Comparison of EM&A Data and EIA Predictions**

# Comparison of 1-hr TSP data with EIA predictions

Station	Predicted 1-hr TSP conc.								
	Scenario1	Scenario2	Reporting M	lonth (Jun	Reporting Mo	nth (Jul 15),	Reporting Month (Aug		
	(Mid	(Mid 2013	15),	μg/m³	μg/	$m^3$	15), μg/m <sup>3</sup>		
	2009 to	to Late	Average	Range	Average	Range	Average	Range	
	Mid	2016),							
	2013),	μg/m <sup>3</sup>							
	μg/m³								
AM2 – Lee Kau Yan	290	312	87.5	37.8 – 128.6	101.6	36.4 – 134.0	95.4	34.0 – 194.2	
Memorial School									
AM3(A) - Holy Trinity	217	247	87.1	59.8 – 111.7	91.4	37.5 – 118.6	91.6	22.3 – 166.0	
Bradbury Centre									
(Alternative station for Sky									
Tower)									
AM4(A) – EMSD	246	258	89.1	66.8 – 128.3	74.8	33.0 – 119.8	105.4	34.3 – 271.3	
Workshops (Alternative									
station for Grand									
Waterfront)									
AM5(A) – Po Leung	159	221	93.1	68.3 – 162.7	72.5	31.9 – 118.0	100.6	31.0 – 264.9	
Kuk Ngan Po Ling College									
(Alternative station for									
CCC Kei To Secondary									
School)									

## **Comparison of 24-hr TSP data with EIA predictions**

Station	Predicted 24-hr TSP conc.								
	Scenario1 Scenario2 (Mid 2013		1 8 %		Reporting Month (Jul 15), μg/m <sup>3</sup>		Reporting Month (Aug 15), μg/m <sup>3</sup>		
	2009 to  Mid 2013),  µg/m <sup>3</sup>	to Late 2016), μg/m <sup>3</sup>	Average	Range	Average	Range	Average	Range	
AM2 – Lee Kau Yan Memorial School	145	169	49.3	29.6 – 74.7	50.2	22.3 – 82.8	31.4	17.7 – 61.0	
AM3(A) - Holy Trinity Bradbury Centre (Alternative station for Sky Tower)	106	138	32.4	23.8 – 52.3	35.9	30.0 – 41.2	48.3	26.4 – 101.9	
AM4(A) – EMSD Workshops (Alternative station for Grand Waterfront)	143	152	44.7	28.5 – 66.8	45.3	20.5 – 74.5	76.1	42.3 – 156.8	
AM5(A) – Po Leung Kuk Ngan Po Ling College (Alternative station for CCC Kei To Secondary School)	103	128	23.0	20.1 – 27.2	31.5	21.2 – 40.1	24.1	15.0 – 33.6	

## **Comparison of Noise Monitoring Data with EIA predictions**

Stations	Predicted Mitigated Construction Noise Levels during Normal Working Hour (Leq (30min) dB(A))	Reporting Month (Jun 15), Leq (30min) dB(A)	Reporting Month (Jul 15), Leq (30min) dB(A)	Reporting Month (Aug 15), Leq (30min) dB(A)
M6(A) - Oblate Primary School ^	N/A	58.4 – 62.9	50.6 – 67.0	57.0 – 62.4
M7 - CCC Kei To Secondary School	45 – 68	57.4 – 61.3	56.7 – 68.0	60.2 – 65.3
M8 - Po Leung Kuk Ngan Po Ling College	44 – 70	51.7 – 58.4	60.6 – 69.4	61.1 – 69.4
M9 - Tak Long Estate	Not predicted in EIA Report	69.7 – 75.0	56.7 – 72.7	59.5 – 72.0

<sup>(^)</sup> Construction noise monitoring at Station M6 – Holy Carpenter Primary School was carried out on  $3^{rd}$  and  $8^{th}$  October 2014 as it was rejected by the premise owner afterwards. An alternative noise monitoring station – M6(A) – Oblate Primary School replaced M6 – Holy Carpenter Primary School from  $10^{th}$  October 2014 onwards.