

### **Drainage Services Department**

## Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O Monthly EM&A Report (June 2023)

Prepared by SGS Hong Kong Limited

**Certified by:** 

Verified by:

Tour Faulberg

Johnathan Ho

F.C. Tsang

**Environmental Team Leader Independent Environmental Checker** 





Our Ref: PL-202307015

**Drainage Services Department** Special Duty Division 42/F, Revenue Tower, 5 Gloucester Road, Wan Chai, Hong Kong.

Attention: Mr. Gary CHUNG

12 July 2023

Dear Gary,

Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Monthly EM&A Report for June 2023

Reference is made to your submission of the Monthly EM&A Report for June 2023 received by email on 7 July 2023 and the subsequent revision on 12 July 2023. We are pleased to inform you that we have no adverse comment on the captioned report.

Thank you for your attention. Please do not hesitate to contact the undersigned should you have any queries.

Yours faithfully,

Toang Fauldery

F.C. Tsang

Independent Environmental Checker

ETL – Johnathan HO cc.



# Drainage Services Department Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O Monthly EM&A Report (Period from 1 to 30 June 2023)

Prepared by

**Drainage Services Department** 

**SGS Hong Kong Limited** 

#### **Issue and Revision Record**

Revision	Description	Prepared by	Checked by	Approved by	Date
01	Submission	Various	Johnathan Ho	Grace Fung	July 2023

#### **Disclaimer**

This document is issued by the Company under its General Conditions of Service accessible at <a href="http://www.sgs.com/en/Terms-and-Conditions.aspx">http://www.sgs.com/en/Terms-and-Conditions.aspx</a>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.



#### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

# Page 3 Ref# EMA2204/03/18 Rev. 01

#### Monthly EM&A Report

Date	Jul 23

#### **TABLE OF CONTENT**

1.	EXECUTIVE SUMMARY4
2.	INTRODUCTION6
3.	AIR QUALITY9
4.	NOISE17
5.	WATER QUALITY21
6.	WASTE MANAGEMENT24
7.	ENVIRONMENTAL SITE INSPECTION AND AUDIT25
8.	FUTURE KEY ISSUES28
9.	CONCLUSION29
APP	ENDIX A – PROJECT ORGANIZATION CHART
APP	ENDIX B – CONSTRUCTION PROGRAMME
APP	ENDIX C – METEORLOGICAL DATA
APP	ENDIX D – AIR QUALITY MONITORING EQUIPMENT CALIBRATION CERTIFICATES
	ENDIX E - METHODOLOGY FOR CORRELATION CALCULATION BETWEEN POTABLE ER DUST METER AND HIGH-VOLUME SAMPLER
APP	ENDIX F – AIR QUALITY AND NOISE IMPACT MONITORING SCHEDULE
APP	ENDIX G - AIR QUALITY MONITORING RESULT
APP	ENDIX H – EVENT AND ACTION PLAN
APP	ENDIX I - NOISE MONITORING EQUIPMENT CALIBRATION CERTIFICATES
APP	ENDIX J - NOISE IMPACT MONITORING RESULT

APPENDIX K - MONTHLY SUMMARY OF WASTE FLOW

APPENDIX L - IMPLEMENTATION SCHEDULE OF RECOMMENDED MITIGATION MEASURES

APPENDIX M - RECOMMENDED MITIGATION MEASURES AND PROACTIVE ENVIRONMENTAL PROTECTION PROFORMA

APPENDIX N - CUMULATIVE STATISTICS ON COMPLAINTS, NOTIFICATIONS OF SUMMONS



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		4
		EMA2204/03/18
Monthly EM&A Report		01
monthly _ma/opon	Date	Jul 23

#### 1. EXECUTIVE SUMMARY

- 1.1 The proposed sewerage works in Po Toi O (hereafter as "the Project") is an environmental enhancement project that aims to improve environmental hygiene of the Po Toi O area. The Environmental Impact Assessment (EIA) Report for the Project (Register No: AEIAR-206/2017) was approved on 27 January 2017. The Environmental Permit (EP) (Permit No.: EP-516/2016) was issued on 27 January 2017 and is the current permit for the Project.
- 1.2 Société Générale de Surveillance (SGS) Hong Kong Limited has been appointed by Drainage Services Department (DSD) under service contract no. SD 3/2022 as the Environmental Team (ET) to undertake the EM&A programme during construction phase of the Project in accordance with the approved EM&A Manual for the Project.
- 1.3 This is the 28<sup>th</sup> monthly Environmental Monitoring & Audit (EM&A) Report prepared by SGS for the Project. This report summarized the monitoring results and audits findings of the EM&A programme under the EP and the EM&A Manual of the Project during the reporting period of 1 June 2023 to 30 June 2023.

#### **Key Construction Works During the Reporting Period**

- 1.4 The main works undertaken during the reporting period are as follows:
  - Major activities in the reporting month:
  - a) Construction of village sewer;
  - b) Slope works;
  - c) Construction of temporary working platform;

#### Summary of Exceedances, Investigation and Follow-up

1.5 There was no action or limit level exceedance record of construction noise and air quality was recorded in the reporting month.

#### **Complaint Handling, Prosecution and Public Engagement**

- 1.6 No complaints, notification of summons and successful prosecution was received in the reporting period. No public engagement activity was conducted in the reporting month.
- 1.7 No notification of summons and successful prosecution was received in the reporting period. No public engagement activity was conducted in the reporting month.
- 1.8 No air quality, noise and water complaints was received in the reporting month.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		5
		EMA2204/03/18
Monthly EM&A Report		01
monthly _ma/opon	Date	Jul 23

#### **Reporting Change of EM&A Programme**

1.9 No reporting change of the EM&A programme in this reporting month.

#### **Future Key Issues**

- 1.10 The main works will be anticipated in the next reporting period are as follows:
- -Major activities in the upcoming month:
  - Construction of village sewer;
  - Slope works.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		6
		EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23

#### 2. INTRODUCTION

#### **Project Information**

2.1 Société Générale de Surveillance (SGS) Hong Kong Limited has been appointed by Drainage Services Department (DSD) as the Environmental Team (ET) to undertake the EM&A programme during construction phase of the Project in accordance to the approved EM&A Manual for the proposed sewerage works in Po Toi O (hereafter as "The Project"), an environmental enhancement project that aims to improve environmental hygiene of the Po Toi O area.

#### **Project Background**

- 2.2 Po Toi O is located in the southern part of Sai Kung District, next to Clear Water Bay. There is a small settlement called Po Toi O village around the bay. There is currently no public sewerage system for the village. Sewage and wastewater generated by local residents and local restaurants are treated by septic tanks/ soakaway system (STS).
- 2.3 Sewage works at Po Toi O comprise sewage collection, treatment and disposal facilities at Po Toi O under Port Shelter Sewerage, Stage 3 Sewerage Works at Po Toi O.
- 2.4 The Project in Po Toi O mainly comprises of the following items:
  - a. Provision of village sewerage to the unsewered areas of Po Toi O. The works involve construction of about 800m of gravity sewers and 400m of rising mains;
  - b. Construction of a local sewage treatment plant (STP) with Average Dry Weather Flow (ADWF) of about 139m3/day; and
  - c. Construction of a submarine outfall of about 385m in length.
- 2.5 The Project consists of the following works, which are classified as Designated Projects under Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO):
  - a. Item Q.1 A sewage treatment plant and portion of sewer alignments in a conservation area;
  - b. Item C.12 (a) (v) and (vii) A dredging operation which is less than 500m from the nearest boundary of an existing fish culture zone and coastal protection area; and
  - c. Item F.6 A submarine sewage outfall.
- 2.6 The Environmental Impact Assessment (EIA) Report "Port Shelter Sewerage, Stage 3 Sewerage Works at Po Toi O" (Register No: AEIAR-206/2017) was approved on 27 January 2017. An Environmental Permit (EP) (Permit No.: EP-516/2016) was issued on 27 January 2017 and is the current permit for the Project. The EM&A programme of the Project shall be implemented in accordance with the requirements and procedures set out in the EM&A Manual and the Environmental Permit (EP) of the Project (Permit No.: EP-516/2016).



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		7
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23

2.7 The air quality and noise baseline monitoring works were conducted from 23 December 2020 to 5 January 2021 and the water quality baseline monitoring work was conducted from 17 December 2020 to 12 January 2021. A Baseline Monitoring Report had been submitted to EPD on 10 March 2021.

#### **Scope of Report**

2.8 This is the 28<sup>th</sup> EM&A Report prepared by SGS for the Port Shelter Sewerage, Stage 3 – Sewerage Works at Po Toi O. This report summarized the monitoring results and audits findings of the EM&A programme under the EP of the Project and in accordance with the EM&A Manual during the reporting period of 1 June 2023 to 30 June 2023.

#### **Project Organisation**

2.9 The project organization structure is shown in **Appendix A**. The key personnel contact names and numbers are summarized in **Table 2-1**.

**Table 2-1 Contact information of key personnel** 

Position	Party	Name	Telephone
Project Proponent	Drainage Services Department (DSD)	Mr. Gary Chung	2594 7227
Senior Resident Engineer (SRE)	Binnies Hong Kong Limited (Binnies)	Mr. Eugene Chan	6392 3809
Independent Environmental Checker (IEC)	Acuity Sustainability Consulting Limited (ASC)	Dr. F.C. Tsang	2698 8060
Environmental Team (ET)	Société Générale de Surveillance (SGS) Hong Kong Limited	Mr. Johnathan Ho	9236 5528
Environmental Officer	China Geo-engineering Corporation (CGC)	Mr. Jasper Tang	6997 5530



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		8
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
monthly Emanticopolit	Date	Jul 23

#### **Construction Programme and Activities**

2.10 The main works undertaken in the reporting period are as follows:

Major activities in the reporting month:

- 1. Construction of village sewer;
- 2. Slope works;
- 3. Construction of temporary working platform;

The Construction Programme is shown in **Appendix B**. The general layout plan of the Project is shown in **Figure 2-1**.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		9
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23

#### 3. AIR QUALITY

#### **Monitoring Requirements**

3.1 In accordance with the EM&A Manual, impact air quality monitoring shall be carried out throughout the construction period at all approved air quality monitoring locations (AMSs). 24- hours total suspended particles (TSP) monitoring shall be conducted at least once every 6 days. Meanwhile, 1-hour TSP monitoring shall be conducted at least 3 times every 6 days when the highest dust impact takes place. The Action and Limit levels for 1-hour and 24-hours TSP level are provided in **Table 3-1** and **Table 3-2**.

Table 3-1 Action and Limit Levels for 1-hour-TSP

Parameter	Air Quality Monitoring Station (AMSs)	Action Level (μg/m³)	Limit Level (μg/m³)
	AMS1N	319	
1-hr TSP (μg/m³)	AMS2N1	279	
	AMS3N	303	500μg/m³
	AMS4N	278	

Table 3-2 Action and Limit Levels for 24-hour-TSP

Parameter	Air Quality Monitoring Station (AMSs)	Action Level (μg/m³)	Limit Level (μg/m³)	
	AMS1N	153		
24-hr TSP (μg/m³)	AMS2N1	179		
	AMS3N	158	260μg/m³	
	AMS4N	144		



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	10
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monany Emarchopers	Date	Jul 23

#### **Monitoring Equipment**

The 24-hour TSP air quality monitoring was performed using High Volume Air Samplers (HVS) at each of the designated monitoring stations. The HVS are calibrated by a HVS calibrator. Meanwhile 1-hour TSP air quality monitoring was performed using portable TSP monitors. The equipment used for air quality monitoring are given in **Table 3-3**.

**Table 3-3 Equipment Used for Air Quality Monitoring** 

Air Quality Monitoring	Brand and Model of Equipment	Serial Number
24-hour TSP*	Graseby GMW High Volume	1180
	Sampler	1174
		9795
		2483
	Tisch TE-5025A High Volume Sampler Calibrator	4128
1-hour TSP	Sibata LD-3B Portable TSP	014746
	Monitors	155331
		597340
		597227

- 3.3 Meteorological information (such as the humidity, rainfall, air pressure and temperature etc.) were collected from Hong Kong Observatory (HKO)'s Weather Stations.
- 3.4 According to the approved EM&A Manual, wind data monitoring equipment shall be provided and setup for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
  - a. The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
  - b. The wind data should be captured by a data logger. The data shall be downloaded for



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	11
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Eman respons	Date	Jul 23

analysis at least once a month.

- c. The wind data monitoring equipment should be re-calibrated at least once every six months.
- d. Wind direction should be divided into 16 sectors of 22.5 degrees each.
- 3.5 It is noted that after liaison with the Po Toi O resident's representative on 22 December 2020, the resident's representative has rejected the access to the space and power supply for ET to install the wind data monitoring stations. Therefore, ET had proposed the alternative method for wind data collection according to section 3.4.7 of EM&A Manual.
- 3.6 The alternative method for wind data collection was adopt the wind data information collected from the HKO's Waglan Island weather station as the representative wind data. Although there are other closer weather stations, Waglan Island Station was selected as it is the nearest weather station that measures wind data information mentioned above.
- 3.7 The meteorological data from HKO's Weather Station is given in Appendix C.

#### **Monitoring Parameters, Frequency and Duration**

3.8 The parameters, duration and frequency for air quality impact monitoring is given in Table 3-4. Monitoring stations AMS1N, AMS2N1, AMS3N and AMS4N were set up in accordance to the requirements for placement of equipment, as set out in section 3.5.3 of the EM&A manual of the Project. Locations of the alternative AMSs are given in **Figure 3-1.** 

**Table 3-4 Monitoring Parameters for Air Quality Monitoring** 

Identification no.	Location	Type of monitoring	Parameters	Frequency
AMS1N*	Footpath above House No. 28 Po Toi O Chuen Road			
AMS2N1*	Open space Approx. 15 m from Hung Shing Temple	TSP	1-hr TSP	1-hour TSP: At least 3 times for 1- hour with every 6 days
AMS3N*	Vacant land near Temporary Structure (House) Rocky Shore		24-hr TSP	24-hour TSP: Once every 6 days
AMS4N*	Resting shelter near Seacrest Villas			



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	12
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	lul 23

#### Notes:

#### **Monitoring Methodology for 24-hour TSP Monitoring**

- 3.9 The HVS was installed in the vicinity of the air quality monitoring stations. The following criteria were considered in the installation of the HVS:
  - a. A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
  - b. The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
  - c. A minimum of 2 meters separation from walls, parapets and penthouse for rooftop sampler.
  - d. A minimum of 2 meters separation from any supporting structure, measured horizontally.
  - No furnace or incinerator flues nearby.
  - f. Airflow around the sampler was unrestricted.
  - g. Permission was obtained to set up the samplers and access to the monitoring stations.
  - h. A secured supply of electricity was obtained to operate the samplers.
  - i. The sampler was located more than 20 meters from any dripline.
  - Any wire fence and gate, required to protect the sampler, did not obstruct the monitoring process.
  - k. Flow control accuracy was kept within ±2.5% deviation over 24-hour sampling period.
- 3.10 The following procedures to be followed for the preparation of filter papers of the HVS:
  - a. Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
  - b. All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than  $\pm 3$  °C; the relative humidity (RH) was < 50% and not variable by more than  $\pm 5$ %. A convenient working RH was 40%.
  - All filter papers were prepared and analysed by a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes.

<sup>\*-</sup> Due to a number of limitations identified at the air quality monitoring stations in the Approved EM&A Manual for the Project, the monitoring location AMS1 – AMS4 were replaced by alternative monitoring location AMS1N – AMS4N, which were approved by ER and IEC.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	13
Works at Po Toi O	Ref#	EMA2204/03/18
Maralla EMOA Barrat	Rev	01

Date

Jul 23

#### Monthly EM&A Report

- 3.11 The following procedures are followed throughout air quality monitoring works:
  - a. The power supply was checked to ensure the HVS works properly.
  - b. The filter holder and the area surrounding the filter were cleaned.
  - c. The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
  - d. The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
  - e. The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied was sufficient to avoid air leakage at the edges.
  - f. Then the shelter lid was closed and was secured with the aluminum strip.
  - g. The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.
  - h. A new flow rate record sheet was set into the flow recorder.
  - i. On site temperature and atmospheric pressure readings were taken and the flow rate of the HVS was checked and adjusted at around 1.1 m3/min and complied with the range specified in the updated EM&A Manual (i.e., 0.6-1.7 m3/min).
  - j. The programmable digital timer was set for a sampling period of 24 hrs, and the starting time, weather condition and the filter number were recorded.
  - k. The initial elapsed time was recorded.
  - I. At the end of sampling, on site temperature and atmospheric pressure readings were taken and the final flow rate of the HVS was checked and recorded.
  - m. The final elapsed time was recorded.
  - n. The sampled filter was removed carefully and folded in half-length so that only surfaces with collected particulate matter were in contact.
  - o. It was then placed in a clean plastic envelope and sealed.
  - p. All monitoring information was recorded on a standard data sheet.
- 3.12 The following procedures are followed for the maintenance and calibration of HVS:
  - a. The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
  - b. 5-point calibration of the HVS was conducted using TE-5025A Calibration Kit prior to the commencement of monitoring. Bi-monthly 5-point calibration of the HVS will be carried out



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	14
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

during impact monitoring. The details for HVS calibration against the TE-5025A Calibration Kit is given in **Appendix D**.

#### Monitoring Methodology for 24-hour TSP Monitoring by Direct Reading Dust Meters

- 3.13 Since power supply for HVS for 24-hour TSP monitoring at alternative monitoring locations (i.e., AMS1N to AMS4N) were rejected, the use of direct reading dust meters is adopted to measure both 1-hour and 24-hour average TSP levels for the reporting month.
- 3.14 In accordance to Condition 3.1 of the Project's EP and Section 3.3 of the Project's EM&A Manual, the proposal for alternative monitoring equipment (i.e., direct reading dust meter) for TSP monitoring was approved by IEC and ER.
- 3.15 The measuring procedures of the direct reading dust meters are given in Section 3.5.10.
- 3.16 24 consecutive 1-hour TSP concentration measurement results is adopted for the evaluation of 24-hour TSP concentration. Results are manually logged daily, during daily maintenance of the dust meter. Calculation of the value of 24-hour TSP concentration is given by the average of 24 calculated 1-hour TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and HVS. Details for the correlation methodology and correlation record are given in Appendix D and Appendix E.
- 3.17 HVS for 24-hr TSP monitoring will be adopted once secured supply of electricity becomes available for any agreed TSP monitoring locations.

#### **Monitoring Methodology for 1-Hour TSP Monitoring**

- 3.18 The measuring procedures of the direct reading dust meters were in accordance with the Manufacturer's Instruction Manual as follows:
  - a. Turn the power on.
  - b. Close the air collecting opening cover.
  - c. Push the "TIME SETTING" switch to [BG].
  - d. Push "START/STOP" switch to perform background measurement for 6 seconds.
  - e. Turn the knob at SENSI ADJ position to insert the light scattering plate.
  - f. Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
  - g. Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
  - h. Pull out the knob and return it to MEASURE position.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	15
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
montally amont troport	Date	lul 23

- i. Push the "TIME SETTING" switch the time set in the display to 3 hours.
- j. Lower down the air collection opening cover.
- k. Push "START/STOP" switch to start measurement.
- 3.19 The following procedures are followed for the maintenance and calibration of direct reading dust meters:
  - a. The 1-hour TSP meter was calibrated at 1-year intervals against with high volume sampler.
  - b. Calibration certificates of the Laser Dust Monitors are provided in **Appendix D**. 1-hour validation checking of the TSP meter against HVS is carried out yearly at the air quality monitoring locations.

#### **Monitoring Results and Observations**

- 3.20 The schedule for environmental monitoring in the reporting period is provided in **Appendix F**.
- 3.21 The air quality monitoring results for 1-hour and 24-hour air quality monitoring are summarized in **Table 3-6** and **Table 3-7**. Air quality monitoring data and graphical presentation of the data are provided in **Appendix G**.

Table 3-6 1-hour Air Quality Monitoring Results in the Reporting Period

Parameter	Monitoring Station	Average (μg/m³)	Range (μg/m³)
	AMS1N	39.9	28 – 64
	AMS2N1	70.4	31– 155
1-hr TSP in μg/m <sup>3</sup>	AMS3N	40.1	22 – 83
	AMS4N	46.1	25 – 107

#### Table 3-7 24-hour Air Quality Monitoring Results in the Reporting Period

Parameter	Monitoring Station	Average (μg/m³)	Range (μg/m³)
	AMS1N	40.0	27 – 67
24-hr TSP in μg/m³	AMS2N1	71.2	33 – 157
	AMS3N	38.0	24 – 75



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	16
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

AMS4N	43.4	25 – 88
-------	------	---------

3.22 No Action or Limit Level exceedances of air quality were recorded in the reporting month. No air quality complaints between 0700 – 1900 hours on normal weekdays (i.e., Mondays to Saturdays) were received in the reporting month.

#### Other Influencing Factors of the Monitoring Results

- 3.23 Major emission sources during air quality monitoring in the reporting period were mainly vehicle emission from Po Toi O Chuen Road and nearby residents' activities.
- 3.24 The event and action plan for air quality monitoring are given in **Appendix H**.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		17
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monuny Emant Report		Jul 23

#### 4. NOISE

#### **Monitoring Requirements**

4.1 In accordance with the EM&A Manual, noise impact monitoring was conducted during daytime construction work on normal weekdays (0700-1900 hours between Monday to Saturday), 1 set of 30-min measurement shall be carried out at approved noise monitoring stations (NMSs) every week based on the measurement procedures under EPD's" Technical Memorandum for the Assessment of Noise from Places Other Than Domestic Premises, Public Places or Construction Sites". The Action and Limit levels for construction noise monitoring is provided in **Table 4-1**.

**Table 4-1 Action and Limit Levels for Construction Noise** 

NMSs ID	Noise Sensitive Receivers	Descriptions	Action Level	Limit Level
NMS1N	PTO_N1	Footpath Above House No. 28 Po Toi O Chuen Road		
NMS2N1	PTO_N2	Open Space Approx. 15 m from Hung Shing Temple	When one documented complaint	
NMS3N	PTO_N3	Vacant Land Near Temporary Structure (House) Rocky Shore	is received from any one of the noise sensitive receivers	75 dB(A)*
NMS4N	PTO_N4	Resting Shelter Near Seacrest Villas		

#### **Monitoring Equipment**

4.2 Noise monitoring was completed using sound level meters at each NMSs. The sound levels meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to calibrate the sound level meters at a given sound pressure level. The equipment used for noise impact monitoring is given in Table 4-2.

**Table 4-2 Noise Monitoring Equipment** 

Equipment	Brand and Model	Serial No. /Equipment ID
Integrated Sound Level Meter	Rion NL-52	00253765



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		18
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emark Report		lul 23

Integrated Sound Level Meter	Rion NL-52	00264520
Integrated Sound Level Meter	Rion NL-31	00773032
Acoustic Calibrator	NC-73	10196943
Acoustic Calibrator	Castle GA607	038641
Anemometer	AZ Instrument – AZ 8908	1064869

#### **Monitoring Locations**

4.3 Due to the limitation posed by the approved monitoring stations set out by the EM&A manual, alternative monitoring stations NMS1N, NMS2N1, NMS3N and NMS4N were proposed in accordance to Section 4.5.3 of the EM&A Manual of the Project and approved from the ER and the IEC. The locations of the NMSs are given in **Figure 3-1**, and the details of the monitoring stations are illustrated in **Table 4-3**.

**Table 4-3 Description of Proposed Noise Monitoring Locations** 

NMSs ID	Location	Type of measurement	Type of Monitoring	Duration
NMS1N*	Footpath above House No. 28			30 mins
	Po Toi O Chuen Road			
NMS2N1*	Open space approximately 15			30 mins
	m from Hung Shing Temple			
NMS3N*	Vacant land near Temporary	Free-Field	Noise	30 mins
	Structure (House) Rocky Shore			
NMS4N*	Resting shelter near Seacrest			30 mins
	Villas			

#### Notes:

<sup>\*</sup>For Free-field measurement, a correction of +3dB(A) should be made to the measured results.

<sup>\*</sup> Due to the limitation posed by the approved monitoring stations set out by the EM&A manual, four alternative representative Noise Quality Monitoring Stations (NMSs) are proposed. The alternative monitoring Locations were approved by ER and IEC.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		19
		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emac Report		Jul 23

#### **Monitoring Parameters and Frequency**

4.4 The monitoring parameters, frequency and duration of impact noise monitoring are summarized in **Table 4-4**.

**Table 4-4 Parameters for Noise Impact Monitoring** 

Parameter and Duration	Frequency
30-mins measurement at each monitoring station between 0700 and 1900 on normal weekdays.  Leq, L10 and L90 would be recorded	At least once per week

#### **Monitoring Methodology**

- 4.5 The measuring procedures of the sound level meter were in accordance with the Manufacturer's Instruction Manual as follows:
  - a. Free-field measurement was made for the noise monitoring stations.
  - b. The sound level meter was set on a tripod at a height of 1.2 m above the ground.
  - c. The battery condition was checked to ensure the correct functioning of the meter.
  - d. Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
    - i. frequency weighting: A
    - ii. Time weighting: Fast
    - iii. Time measurement: Leq(30-minutes) during non-restricted hours i.e., 07:00 1900 on normal weekdays; Leq(5-minutes) during restricted hours i.e., 19:00 23:00 and 23:00 07:00 of normal weekdays, whole day of Sundays and Public Holidays
  - e. Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator at a specified sound pressure level at a specified frequency. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
  - f. During the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
  - g. Noise measurement was paused during periods of high intrusive noise (e.g., dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
  - h. Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	20
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Linux Report		Jul 23

- 4.6 The following procedures are followed for the maintenance and calibration of sound level meters:
  - a. The microphone head of the sound level meter was cleaned with soft cloth at regular
  - b. intervals.
  - c. The meter and calibrator were sent to the supplier or HOKLAS laboratory to check
  - d. and calibrate at yearly intervals.
  - e. Calibration certificates of the sound level meters, and acoustic calibrators are provided in **Appendix I.**

#### **Monitoring Results and Observations**

- 4.7 The schedule for environmental monitoring in the reporting period is provided in **Appendix F**.
- 4.8 The monitoring results for construction noise are summarized in **Table 4-5**. The noise monitoring data graphical presentation of the data is provided in **Appendix J**.

Table 4-5 Summary of Construction Noise Monitoring Results in the Reporting Period

NMSs ID	Construction Noise	Baseline Level, dB(A)	Limit Level, db(A)
	Level,		
	dB(A)*, Leq (30 min)		
NMS1N	65.7 dB(A)	62.7 dB(A)	75
NMS2N1	60.9 dB(A)	61.8 dB(A)	75
NMS3N	56.7 dB(A)	64.6 dB(A)	75
NMS4N	55.0 dB(A)	58.1 dB(A)	75

Note:

- 4.9 No Action or Limit Level exceedance of construction noise was recorded in the reporting month.
- 4.10 No noise complaints from between 0700 1900 hours on normal weekdays was received in the reporting month.
- 4.11 The event and action plan are provided in **Appendix H**.

#### Other Influencing Factors of the Monitoring Results

4.12 Major noise sources during noise monitoring in the reporting period were mainly road traffic noise.

<sup>\*-</sup> A correction of +3 dB(A) was made to the free field measurements. Leq (30min) was measured at 0700-1900 hours on normal weekdays.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		21
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Eman Report		Jul 23

#### 5. WATER QUALITY

#### **Monitoring Requirements**

- 5.1 With the recommendations of the Project's EIA report, water quality impact monitoring shall be carried out carried out 3 days per week, at mid-flood and mid-ebb tides (within ± 1.75 hour of the predicted time required) at all the approved Water Quality Monitoring Stations (WQMSs) during whole cofferdam installation/extraction work and during dredging works. The interval between two sets of monitoring shall not be less than 36 hours.
- 5.2 Replicate in-situ measurements of Suspended Solids (SS) and in-situ water quality data (temperature, pH, turbidity, water depth, salinity, dissolved oxygen and percentage of saturation) shall be collected.
- 5.3 Other relevant data should also be recorded, including monitoring location/position, time, tidal stages, weather conditions and any special observation or works that may affect the monitoring results in the vicinity.
- 5.4 To ensure sufficient data for robust analysis, duplicate in-situ data shall be collected. In case the difference in the duplicate in-situ measurement results is larger than 25%, the third set of in-situ measurement shall be carried out for result confirmation purpose.
- 5.5 Water samples shall be extracted at 1m below surface, 1m above seabed and the mid-depth level at where the water depth is at least 6m. However, if the water depth is less than 3m, water samples shall only be collected at the mid-depth level. For stations with depth less than 6m, the mid-depth sample can be omitted.
- 5.6 In addition, duplicated water samples for suspended solid analysis shall be collected at all the above stations and delivered to the HOKLAS accredited laboratory for analysis. Results for suspended solids shall be received back from the laboratory within 24-hour of the receipt of the samples.
- 5.7 Water quality impact monitoring shall also be conducted at the same frequency as monitoring throughout the whole cofferdam installation/extraction work and during dredging work. In case of exceedance of Action/Limit Level recorded, the frequency of water quality monitoring shall be increased as per the Event and Action Plan.
- 5.8 The water quality impact monitoring schedule shall be issued to IEC at least one month prior to the commencement of Impact Monitoring.

#### **Monitoring Parameters and Frequency**

5.9 The monitoring parameters, monitoring periods and frequencies of the water quality monitoring are summarized in **Table 5-1**.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	22
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emarchoport		lul 23

**Table 5-1 Parameters of Water Quality Monitoring** 

Parameters	Duration	Frequency
Temperature (Oc)	During Construction Phase:	3 Days Per Week
Ph (Ph Unit)	Throughout Installation	(The Interval Between Two
Turbidity (Ntu)	And Extraction Of	Sets of Monitoring Shall Not
Water Depth (M)	Cofferdam; And	Be Less Than 36 Hours.)
Salinity (Ppt)	During Dredging	
Do (Mg/L And % Of		
Saturation)		
SS (Mg/L)		

#### **Monitoring Locations**

5.10 According to section 5.2.6 of the EM&A manual of the project, 6 water quality monitoring stations (WMSs) are proposed at the Po Toi O FCZs, major amphioxus habitats and rocky shores where coral thrives. With reference to the tidal characteristics of Po Toi O Bay, 3 control stations are proposed where fresh marine water is not affected by the cofferdam installation/ extraction works, and 2 impact stations are proposed near the cofferdam under different tidal periods. All water quality monitoring stations show as **Figure 5-1** and **Table 5-2**.

**Table 5-2 Summary of Water Quality Impact Monitoring Stations** 

Station	Monitoring period	Description	Easting	Northing
*WMS1N	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848416	845209
*WMS2N	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848505	815375
WMS3	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848644	815391
WMS4	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848774	815602
WMS5	Mid-Ebb, Mid-Flood	Rocky Shore with Corals	848578	815591
WMS6	Mid-Ebb, Mid-Flood	Major Amphioxus Habitat	848639	815523
I1	Mid-Flood	Impact monitoring Station	848643	815692
12	Mid-Ebb	Impact monitoring Station	848722	815910
C1	Mid-Flood	Control station	848904	816052
C2	Mid-Ebb	Control station	848529	815373
C3	Mid-Ebb	Control station	848243	815710
WMS1	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848387	815201
WMS2	Mid-Ebb, Mid-Flood	Po Toi O Fish Culture Zone	848479	815378

Notes:



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		23
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23

\*WMS1N, WMS2N are new proposed alterative monitoring location. As previous EIA proposed monitoring location WMS1, WMS2 are situated in fish barges within the Fish Culture Zone (FCZ), and accesses to WMS1 and WMS2 were subsequently denied by the tenants of the fish barges. The relocation of WMS1 and WMS2 were approved by IEC and the ER of the Project.

#### **Results and Observations**

- 5.11 According to submission of construction works schedule and location plan under the EP of Project, the proposed period of commencement construction work with cofferdam installation / extraction work and during dredging works is August 2023.
- 5.12 Marine construction was not commenced within the reporting month; hence no water quality monitoring was conducted.
- 5.13 Refer to Sections 5.2.10 and 5.2.11 of approved EM&A Manual, construction phase site inspection for water quality mitigation measures and check the contractor's work practice on water pollution prevention during construction phase has been conducted during weekly site audit.
- 5.14 During the weekly site audit of this reporting month, no non-conformance water pollution was identified / observed in the commencement works area.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		24
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
		lul 22

#### 6. WASTE MANAGEMENT

- 6.1 As advised by the Contractor, 4 m³ of inert C&D material was generated in the reporting month. For C&D wastes, 0 m³ of general refuse was disposed of at NENT landfill, 0 kg waste were collected by recycling contractors, and 0 kg of chemical wastes was collected by licensed Contractors in the reporting period.
- 6.2 The actual amounts of different types of waste generated by the activities of the Project in the reporting period are shown in **Table 6-3**, the detailed monthly summary of waste flow is detailed in **Appendix K**.

**Table 6-3 Summary of Waste Flow Table** 

Waste Type	Quantity	Disposal/ Reuse Locations
Inert C&D Waste Disposed as	4 m <sup>3</sup>	Tseung Kwan O Area 137 Fill
Public Fill		Bank (TKO137FB).
C&D Wastes Disposed as General	0 m <sup>3</sup>	North East New Territories
Refuse		(NENT)
Recycle Materials	0 kg	Recycling Facilities
General Refuse	0 kg	North East New Territories
		(NENT)
Chemical Waste	0 kg	Licensed Contractors

6.3 During regular site auditing, the mitigation measures proposed in the Implementation Schedule of the Environmental Mitigation Measures (EMIS) in the approved EIA report of the Project has been effectively implemented in the commenced works area. No adverse waste impact was observed from the construction works in reporting month.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	25
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23

#### 7. ENVIRONMENTAL SITE INSPECTION AND AUDIT

#### **Site Inspection**

- 7.1 Site inspections were carried out by ET on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. Key observations were recorded in the site inspection checklist and passed to the Contractor together with the appropriate recommended mitigation measures where necessary.
- 7.2 In the reporting period, 5 site inspections were carried out on 1, 8, 15, 23 and 29 June 2023. No noncompliance was recorded during the site inspection. Details of observations recorded during the site inspections are presented in **Table 7-1**.

Table 7-1 Observations and Recommendations in the Reporting Month

Date	Parameters	Observations and Recommendations	Action was taken by
			the contractor
1	Water Quality	Reminder	Follow up Reminder
June 2023		Reminder 1: The contractor is remidned	Item 1: The contractor
		to maintain silt removal facilities and	shall continuously
		channels after rainstorm events.	maintain the facilities
			and channels after
			rainstorm events. (Item
			Closed)
11	N/A	No particular findings during inspection	N/A
June 2023			
18	N/A	No particular findings during inspection	N/A
June 2023			
23	Water	Reminder	Follow up Reminder
June 2023	Quality/Waste	Reminder 1: The contractor is reminded	Item 1: The contractor
	management	to cover stockpiles with sufficient	has covered up the
		sandbags at PTO-32 and 56 to prevent	working areas and
		muddy water discharge to nearby	provided sandbags to
		drainage facilities and the sea.	prevent muddy water
			discharge. (Item
			Closed)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		26
		EMA2204/03/18
Monthly EM&A Report		01
montally amon't report	Data	lul 22

Date	Parameters	Observations and	Recommendations	Action was taken by the contractor
29	Air Quality/Water	Observation		Follow up
June 2023	Quality	Observation 1: The air compressor at PT		Observation
		The contractor shoul	d replace the NRMM	Item 1: action to be
		label.		taken
		Observation 2: The provide remedial me channel at PTOSTP muddy water dischardrains.	asures to the U-regularly to avoid	Item 2: The contractor has provided filter sheets to remove sediments from the effluent and is replaced at a regular basis (Item Closed)
No adverse observ	ation was identified in	the reporting period.	Noise Impact	
No adverse observ	No adverse observation was identified in the reporting per		Ecology	
No adverse observation was identified in the reporting period.		Fisheries		
No adverse observ	No adverse observation was identified in the reporting period.		Built Heritage	
No adverse observation was identified in the reporting period.		Landscape and Visua	al Impact	
No adverse observ	ation was identified in	the reporting period.	Miscellaneous	

#### Status of Environmental Licenses, Notification and Permits

7.3 The environmental licenses and permits for the Project and valid in the reporting period are summarized in **Table 7-3**.

Table 7-3 Status of Environmental License, Notification and Permit

License/ Notification/ Permit	Reference No.	Valid Period	
		From	То
Environmental Permit	EP-516/2016	27 January 2017	End of Project
Construction Dust Notification	458613	3 August 2020	N/A
Under APCO			
Wastewater Discharge License	WT00038707-	3 November 2021	31 August 2026
	2021		
Chemical Waste Producer	5213-820-	23 September 2020	N/A
Registration	C3510-		



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		27
Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report		01
monthly Emant respons	Date	Jul 23

	18		
Billing Account for Disposal of	WFG22785	17 August 2020	N/A
Construction Waste			

#### Implementation Status on Environmental Protection Requirements

7.4 The Implementation Schedule of the Environmental Mitigation Measures (EMIS) of the reporting period is summarized in **Appendix L**. The implementation of the key mitigation measures during the reporting period is presented in **Appendix M**.

# Summary of Complaints, Notification of Summons, Successful Prosecutions and Public Engagement Activities

- 7.5 No complaints, notification of summons and successful prosecution was received in the reporting period. No public engagement activities were conducted in the reporting period.
- 7.6 Statistics on complaints, notifications of summons, successful prosecutions and public engagement activities are summarized in **Appendix N**.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	28
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

#### 8. FUTURE KEY ISSUES

#### CONSTRUCTION PROGRAMME FOR THE UPCOMING REPORTING MONTH

- 8.1 Major activities in the upcoming month:
  - a. Construction of village sewer;
  - b. Slope works.

#### Reinstatement Works Key Issues for the Upcoming Reporting Month

- 8.2 Potential environmental impacts due to the construction activities, including air quality, noise, water quality, waste, landscape and visual, will be monitored or reviewed. The ET will continue to implement the environmental monitoring & audit programme in accordance with the EM&A Manual and Environmental Permit requirement. The recommended environmental mitigation measures shall be implemented on site and regular inspections as required will be carried out to ensure that the environmental conditions are acceptable.
- 8.3 The anticipated impact of major work activities within the site and the recommended mitigation measures are shown in **Appendix M**.

#### **Monitoring Schedule for the Coming Month**

8.4 The tentative schedule for environmental monitoring in July 2023 is provided in **Appendix F**.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	29
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

#### 9. CONCLUSION

#### General

9.1 This Report Summarized the Monitoring Results and Audits Findings of the EM&A Programme Under the EP of The Project and In Accordance with the EM&A Manual During the Reporting Period of 1 June 2023 to 30 June 2023.

#### **Environmental Impact Monitoring**

9.2 No Action or Limit Level exceedance of construction air quality, noise was recorded in the reporting month. No air quality complaints and noise complaints were received in the reporting month.

#### **Environmental Site Inspections**

9.3 The environmental site inspections were carried out in the reporting month. Recommendations on remedial actions were given to the contractors for the deficiencies identified during the site inspection. The contractor had been follow-up the recommendations on the remedial action accordingly.

#### **Complaint Log**

9.4 There was no complaint received in relation to the environmental impact during the reporting period.

#### **Reporting Changes**

9.5 No report changes in this reporting period.


#### **Notifications of Summons and Successful Prosecutions**


9.6 There was no notification of summons and successful prosecution was received in the reporting period.





EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	-
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

#### FIGURE 2-1 – LAYOUT PLAN OF THE CAPTIONED PROJECT

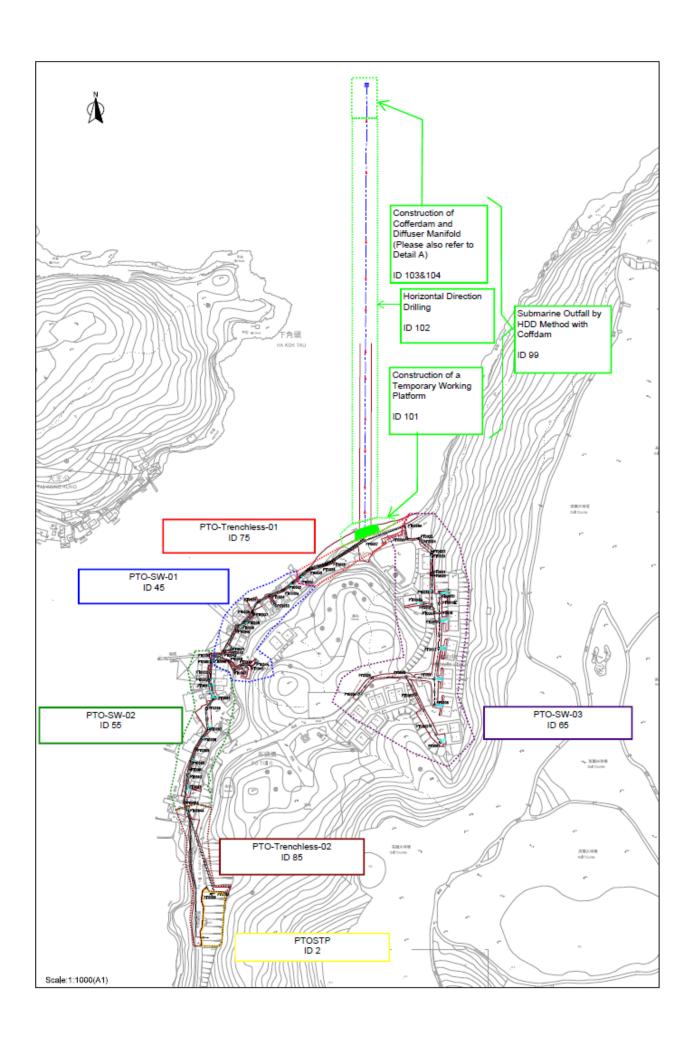

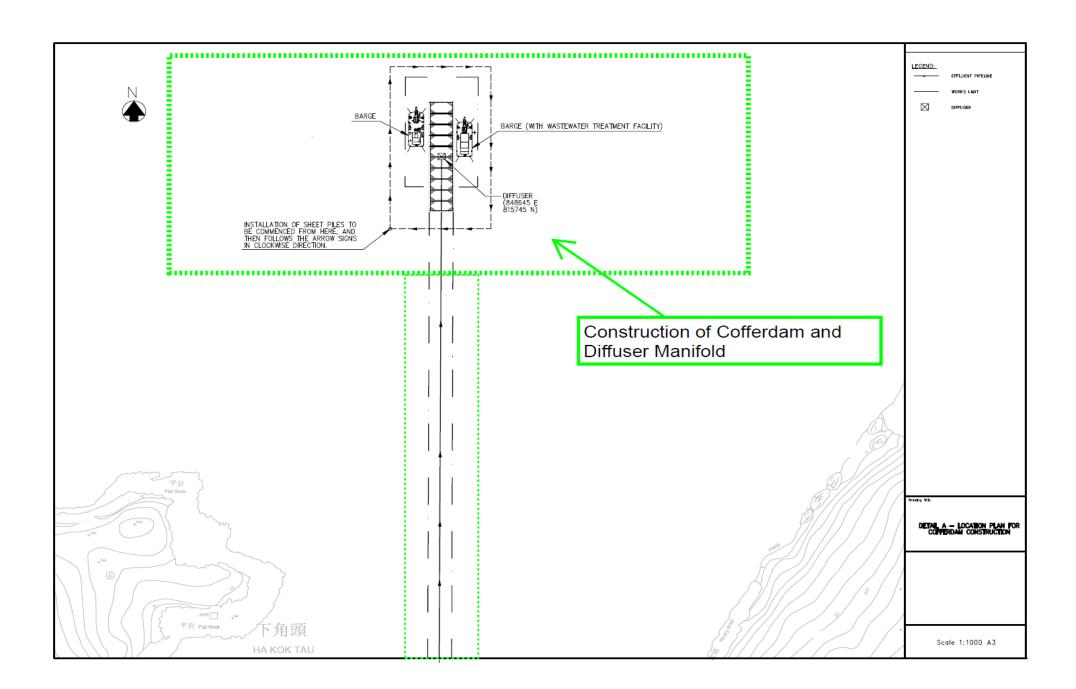

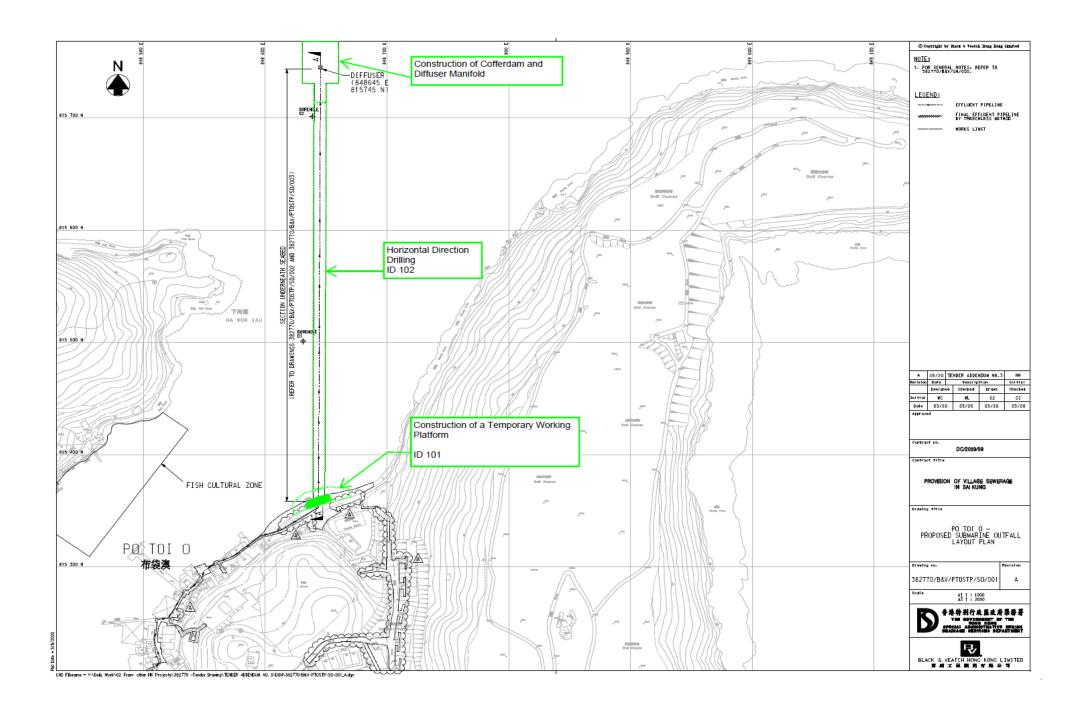


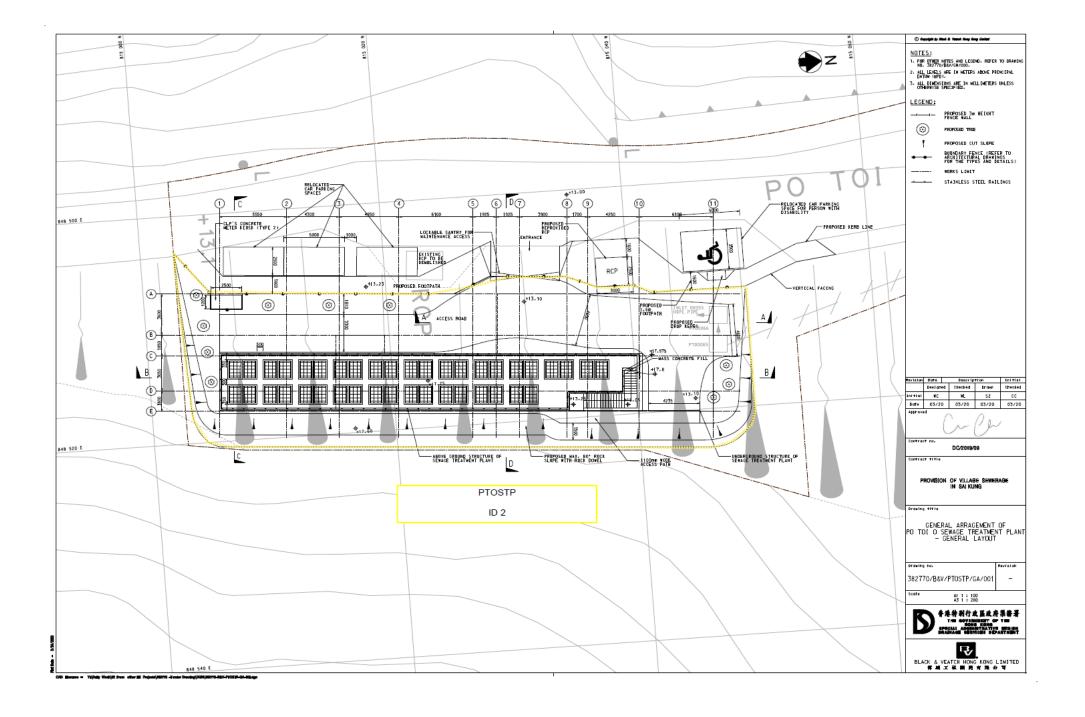



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	-
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23


### FIGURE 3-1 PROPOSED AIR QUALITY AND NOISE MONITORING STATIONS LOCATIONS

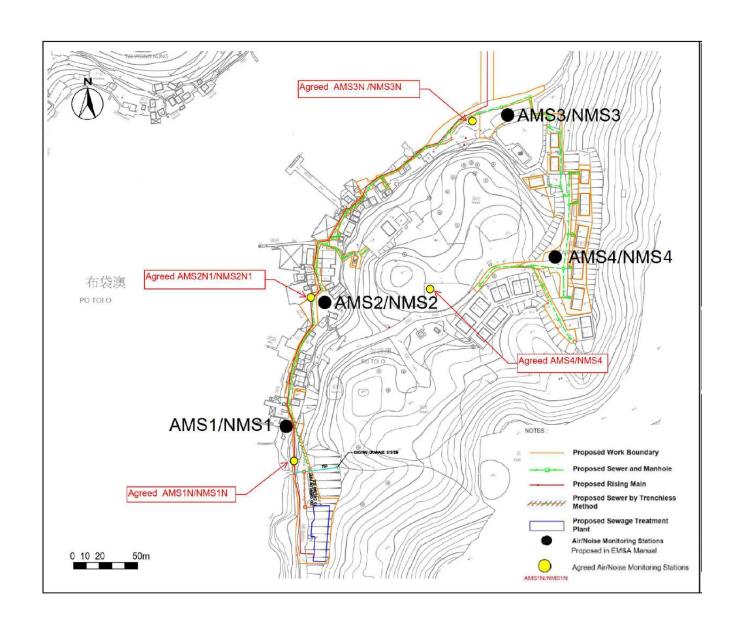



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	-
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

### FIGURE 5-1 LOCATIONS OF WATER QUALITY IMPACT MONITORING STATIONS

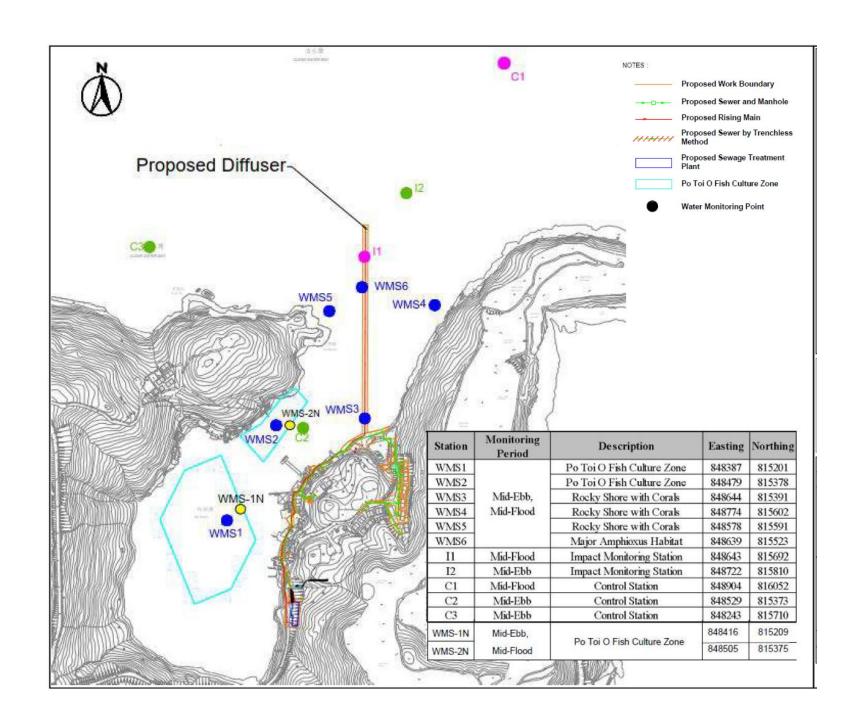




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	A-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly =max respons		Jul 23

### **APPENDIX A - PROJECT ORGANIZATION CHART**



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page Ref# A-2 Monthly EM&A Report Rev. 01 Date Jul 23

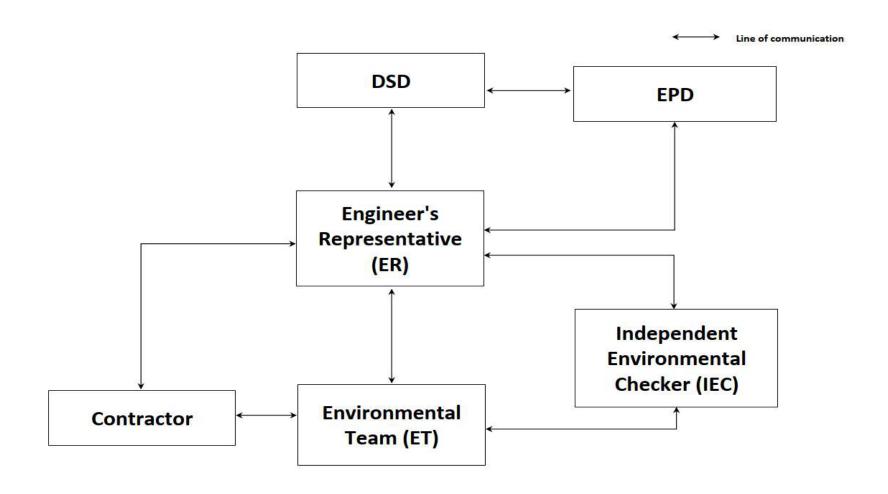




#### 

Contract No.: DC/2019/09

### Provision of Village Sewerage in Sai Kung


### Environmental Organization Chart for Po Toi O

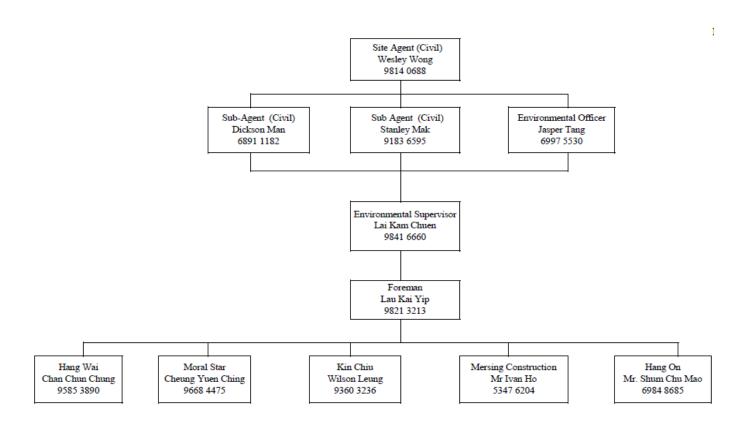



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		B-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

### **APPENDIX B - CONSTRUCTION PROGRAMME**

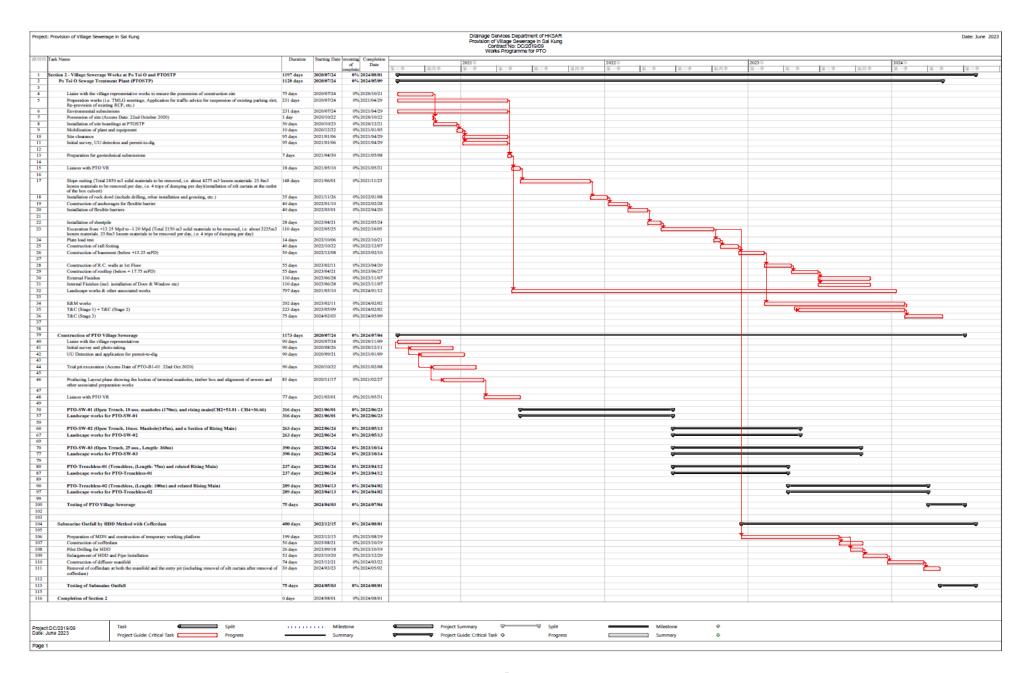



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	C-1		
Works at Po Toi O	Ref#	EMA2204/03/18		
Monthly EM&A Report	Rev.	01		
	Date	Jul 23		

### APPENDIX C - METEORLOGICAL DATA



### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

Monthly EM&A Report

C-2 Page EMA2204/03/18 Ref# Rev. 01

Jul 23

Date

	Hong Kong Observatory								King's Park	Waglan Is	land^
	Mean	Air 1	emper		Mean	Mean	Mean	Total	Total Bright	Prevailing	Mean
Day	Pressure (hPa)	Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)	Dew Point (deg. C)	Relative Humidity (%)	Amount of Cloud (%)	Painfall	Sunshine (hours)	Wind Direction (degrees)	Wind Speed (km/h)
01	1002.8	31.6	29.2	26.2	25.1	79	71	6.0	***	***	***
02	1004.8	35.2	30.7	28.2	25.9	76	48	0.0	***	***	***
03	1007.6	34.9	30.8	28.9	26.1	76	47	0.6	***	***	***
04	1008.4	32.7	30.0	27.9	26.2	81	65	5.1	***	***	***
05	1007.9	32.9	29.7	27.7	25.7	79	83	4.8	***	***	***
06	1007.8	30.2	28.4	26.8	26.0	87	90	31.1	***	***	***
07	1008.7	31.5	28.5	27.0	26.2	88	85	27.1	***	***	***
08	1007.1	33.1	29.4	27.4	25.9	82	79	2.6	***	***	***
09	1004.2	32.0	29.0	26.7	25.8	83	86	16.8	***	***	***
10	1001.9	33.0	29.5	28.0	25.4	79	85	0.3	***	***	***
11	1001.6	32.5	29.2	27.3	25.9	83	86	25.4	***	***	***
12	1001.9	33.7	30.2	28.2	25.6	77	82	0.2	***	***	***
13	1002.6	32.7	29.8	25.8	26.2	81	86	31.8	***	***	***
14	1004.9	29.6	27.7	25.1	25.4	88	92	62.8	***	***	***
15	1005.1	28.7	27.4	26.1	25.7	91	88	41.5	***	***	***
16	1007.1	28.1	26.4	25.2	25.0	92	90	41.7	***	***	***
17	1009.3	28.0	26.2	25.3	25.2	94	90	89.9	***	***	***
18	1008.9	29.9	28.0	25.7	25.9	89	88	35.8	***	***	***
19	1007.5	31.4	29.1	26.9	26.0	83	87	10.2	***	***	***
20	1007.0	32.2	30.0	27.8	26.1	80	79	2.3	***	***	***
21	1007.4	32.2	30.2	28.7	26.1	79	85	1.9	***	***	***
22	1007.2	32.4	30.2	29.0	25.8	77	88	0.6	***	***	***
23	1006.5	31.2	30.0	28.0	26.1	80	88	2.3	***	***	***
24	1007.1	31.0	29.1	27.4	26.3	85	88	8.2	***	***	***
25	1008.2	32.9	29.4	26.1	26.0	83	88	13.0	***	***	***
26	1008.5	32.9	29.4	26.6	26.2	83	88	11.4	***	***	***
27	1009.5	33.9	30.1	28.1	26.1	80	76	Trace	***	***	***
28	1009.9	31.3	28.8	26.9	26.2	86	84	5.4	***	***	***
29	1006.9	33.3	29.5	27.1	26.3	84	84	0.9	***	***	***
30	1005.6	32.5	29.8	26.5	26.3	82	83	11.2	***	***	***
Mean/Total	1006.5	31.9	29.2	27.1	25.9	83	82	490.9	***	***	***
Climatological Normal?	1006.1	30.7	28.3	26.5	24.9	82	77	491.5	144.3	220	21.6

Source: https://www.hko.gov.hk/en/cis/dailyExtract.htm?y=2023&m=06



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-1	
Works at Po Toi O	Ref#	EMA2204/03/18	
Monthly EM&A Report	Rev.	01	
	Date	Jul 23	

### APPENDIX D – AIR QUALITY MONITORING EQUIPMENT CALIBRATION CERTIFICATES



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-2
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23



8/F Block B, Veristrong Industrial Centre 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsult.com

### TEST REPORT

### Internal Calibration Report

of t Monito

Dust Monitor

Manufacturer : SIBATA (LD-3B) Date of Calibration :

06 April 2023

Serial No.

: 014746 (ET/EA/001/06)

Calibration Due Date:

05 June 2023


Method

: Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	24	57	73	139	181	
TSP (ug/m <sup>3</sup> )	43	87	135	228	311	
High Volume Air Sampler Serial No.: 1180	Calibration Due Date: 27 April 2023					

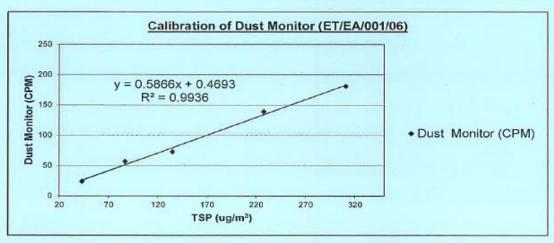

Acceptance Criteria;

Correlation coefficient (r) of the calibration curve greater than 0.990 after five-point calibration.

The Dust Trak Monitor complies \* / does-not-comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by :

CHENG, Hei Man (Technician) Checked by

(Laboratory Manager)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-3
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23



### TEST REPORT

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

05 June 2023

Serial No.

: 014746 (ET/EA/001/06)

Calibration Due Date :

04 August 2023


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

:	Dust Monitor (CPM)	26	54	75	139	183
	TSP (ug/m³)	42	82	133	225	317
	High Volume Air Sampler Serial No : 1180	Calibration Due Date: 25 June 2023				

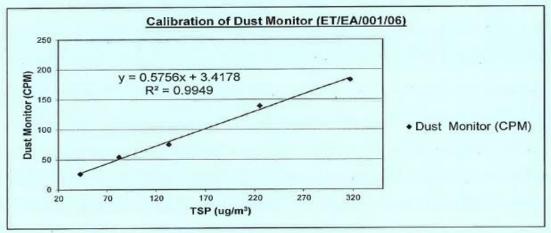

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after five-point calibration.

The Dust Trak Monitor complies \* / dees not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

(Technician)

- END OF REPORT -

Checked by

(Caboratory Manager)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page
	Ref#

Monthly EM&A Report

Page	D-4
Ref#	EMA2204/03/18
Rev.	01

Jul 23



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

Date

T; +852 2695 8318 F; +852 2695 3944 li@ets-testconsult.com ww.ets-testconsult.com

### TEST REPORT

### Internal Calibration Report

of **Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

06 April 2023

Serial No.

: 597340 (ET/EA/001/14)

Calibration Due Date:

05 June 2023


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	33	51	82	137	184
TSP (ug/m <sup>3</sup> )	41	78	123	184	251
High Volume Air Sampler Serial No.: 1174	Calibration Due Date: 27 April 2023				

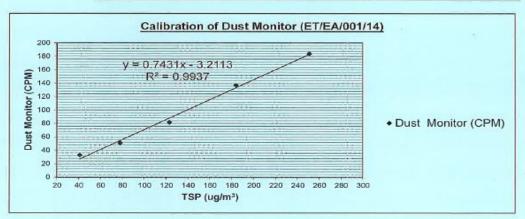

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by : CHENG, Hei Mar (Technician)

Checked by :

(Laboratory Manager)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-5
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23



### TEST REPORT

### Internal Calibration Report

of

#### **Dust Monitor**

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

05 June 2023

Serial No.

: 597340 (ET/EA/001/14)

Calibration Due Date:

04 August 2023


Method

: Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	36	54	83	134	181
TSP (ug/m <sup>3</sup> )	43	76	126	185	252
High Volume Air Sampler, Serial No : 1174	Calibration Due Date: 25 June 2023				

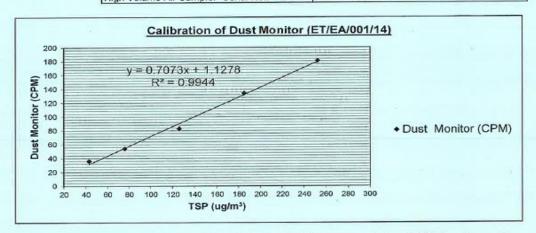

Acceptance Criteria;

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point calibration

The Dust Trak Monitor complies \* / does-not-comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by

CHENG, Hei Man (Technician)

Checked by

Guy, Keng Ping Ki. (Laboratory Manager)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-6
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23



### TEST REPORT

#### Internal Calibration Report of

**Dust Monitor** 

Manufacturer : SIBATA (LD-3B)

Date of Calibration

: 06 April 2023

: 155331 (ET/EA/001/09)

Calibration Due Date

: 05 June 2023


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	41	82	154	185	249
TSP (ug/m³)	54	111	184	244	306
High Volume Air Sampler Serial No.: 9795	Calibration Due Date: 26 April 2023				

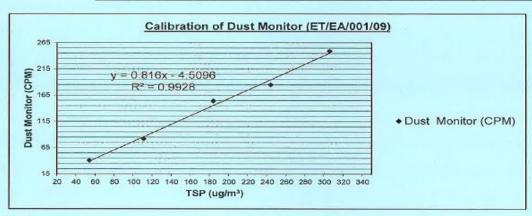

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point

The Dust Trak Monitor complies \* / dees not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by : CHENG, Hei Man (Technician)

Checked by

Guy, Kong Ping Ki (Laboratory Manager)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-7
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23



6/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +852 2695 3944 E: ell@ets-testconsult.com W: www.ets-testconsult.com

### TEST REPORT

### Internal Calibration Report

of <u>Dust Monitor</u>

Manufacturer : SIBATA (LD-3B)

Date of Calibration

: 05 June 2023

Serial No.

: 155331 (ET/EA/001/09)

Calibration Due Date

: 04 August 2023


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	43	83	151	183	245
TSP (ug/m <sup>3</sup> )	57	114	181	239	308
High Volume Air Sampler Serial No.: 9795	Calibration Due Date: 25 June 2023				

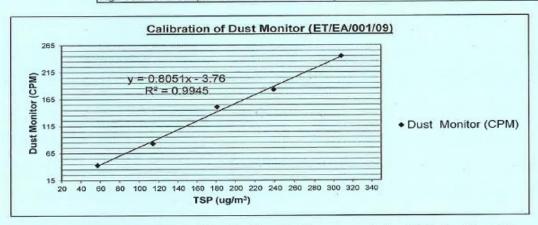

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point calibration

The Dust Trak Monitor complies \* / does\_not\_comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

CHENG, Hei Mar

(Technician)

Checked by

Guy, Kong Ping Ki (Laboratory Manager)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-8
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23



### TEST REPORT

### Internal Calibration Report

#### of **Dust Monitor**

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

06 April 2023

Serial No.

: 597227 (ET/EA/001/15)

Calibration Due Date:

05 June 2023


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

Dust Monitor (CPM)	28	43	69	95	131
TSP (ug/m <sup>3</sup> )	48	78	139	186	243
High Volume Air Sampler Serial No.: 2483	Calibration Due Date: 27 April 2023				

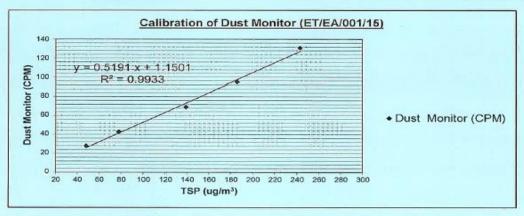

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:
CHENG, Hei Man (Technician)

Checked by :



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		D-9
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
,	Date	Jul 23



### TEST REPORT

### Internal Calibration Report of **Dust Monitor**

Manufacturer : SIBATA (LD-3B)

Date of Calibration :

05 June 2023

Serial No.

: 597227 (ET/EA/001/15)

Calibration Due Date:

04 August 2023


Method

Parallel measurement (Five-point calibration) by placing the Dust Monitor

and High Volume Air Samper together under the same environmental condition

Results

129 93 68 Dust Monitor (CPM) 41 187 244 142 TSP (ug/m³) 79 50 Calibration Due Date: 25 June 2023 High Volume Air Sampler Serial No.: 2483

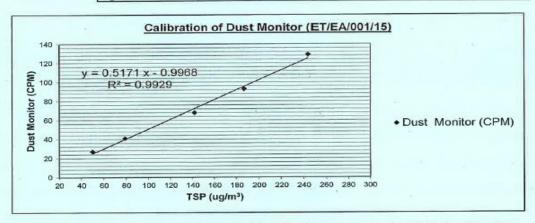

Acceptance Criteria:

Correlation coefficient (r) of the calibration curve greater than 0.990 after a five-point calibration

The Dust Trak Monitor complies \* / does not comply \* with the internal calibration procedures and is deemed acceptable \*/ unacceptable \* for use.

Calibrated by:

CHENG, He (Technician) Checked by



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-10
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01

-		46
	Name and Address of the Owner, where	
	1	
	1	

Date

Jul 23

T: +852 2895 8318 F: +852 2695 3944 etl@ets-testconsult.com www.ets-testconsult.com

#### **TEST REPORT**

### Calibration Report of High Volume Air Sampler

Manufacturer

: Graseby GMW

Date of Calibration

: 26 April 2023

Serial No.

: 2483 (ET / EA / 003 / 26)

Calibration Due Date : 25 June 2023

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm) 57			46	41	37	28
Qstd (Actual flow rate, m³/min) 1.55			1.33	1,16	0.99	0.76
Pressure: 761.01 mm Hg		Temp. :	295	K		

### Sampler 2483 Calibration Curve Site: Tuen Mun CWSF (TM2)

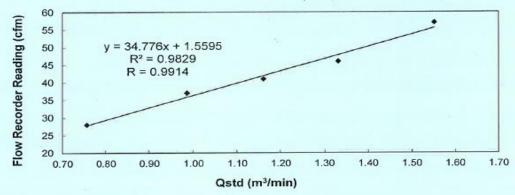

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does-not-comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by

(Assistant Supervisor)

Checked by:

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	
Works at Po Toi O	ı

### Monthly EM&A Report

Page	D-11
Ref#	EMA2204/03/18
Rev.	01

Jul 23



### 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

Date

### TEST REPORT

### Calibration Report

#### High Volume Air Sampler

Manufacturer

Graseby GMW

Date of Calibration

: 24 June 2023

Serial No.

2483 (ET / EA / 003 / 26)

Calibration Due Date : 23 August 2023

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder read	ing (cfm)	53	44	40	34	26
Qstd (Actual flow ra	ate, m³/min)	1.52	1.30	1.13	0.95	0.73
Pressure:	755.39 mm Hg		Temp.:	302	K	

#### Sampler 2483 Calibration Curve Site: Tuen Mun CWSF (TM2)

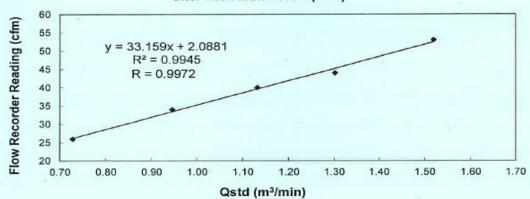

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / dees-not-comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by :

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-12	
Works at Po Toi O	Ref#	EMA2204/03/18	
Monthly EM&A Report	Rev.	01	

1	CAN PA
-	-
1	

8/F Block B, Veristrong Industrial Centre 34-36 Au Pui Wan Street, Fe Tan, Hong Keng

Date

Jul 23

T: +852 2695 8318 F: +652 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com

### TEST REPORT

### Calibration Report of High Volume Air Sampler

Manufacturer

: Graseby 105

Date of Calibration

26 April 2023

Serial No.

9795 (ET/EA/003/18)

Calibration Due Date

25 June 2023

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the

Operations Manual

Results

Flow recorder reading (cfm)	51	46	35	29	24
Qstd (Actual flow rate, m <sup>3</sup> /min)	1.69	1.51	1.26	1.10	0.90
Pressure: 761.01 mm Hg		Temp.:	295	K	61 10

#### Sampler 9795 Calibration Curve Site: Tseung Kwan O 137 (TKO-A1)

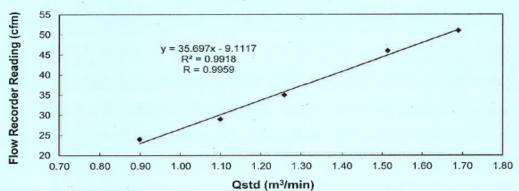

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / dees not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by :

MAK, Kei Wai

(Assistant Supervisor)

Checked by :

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-13
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emax Report		Jul 23



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +652 2695 8318 F: +852 2695 3944 E: eti@ets-testconsult.com W: www.ets-testconsult.com

### TEST REPORT

### Calibration Report of High Volume Air Sampler

Manufacturer

: Graseby 105

Date of Calibration

: 23 June 2023

Serial No.

9795 (ET/EA/003/18)

Calibration Due Date

: 22 August 2023

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the

Operations Manual

Results

Flow recorder rea	ding (cfm)	48	42	32	26	21
Qstd (Actual flow	rate, m <sup>3</sup> /min)	1.65	1.47	1.23	1.05	0.84
Pressure:	754.94 mm Hg		Temp.:	303	K	

### Sampler 9795 Calibration Curve Site: Tseung Kwan O 137 (TKO-A1)

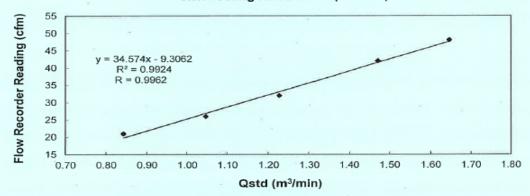

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / dees not comply\* with the specified requirements and is deemed acceptable\*/ unacceptable\* for use.

Calibrated by:

MAK Kei Wai

(Assistant Supervisor)

Checked by 3:

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-14
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

	1
1000	
1	

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

T: +852 2695 8318 F: +652 2695 3944 E: etl@ets-testconsult.com

### TEST REPORT

### Calibration Report of High Volume Air Sampler

Manufacturer

: Graseby GMW

Date of Calibration

: 26 April 2023

Serial No.

: 1174 (ET / EA / 003 / 08)

Calibration Due Date

25 June 2023

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm)	55	49	42	30	24
Qstd (Actual flow rate, m³/min)	1.53	1.34	1.16	0.96	0.82
Pressure:	761.01 mm Hg	Temp.:	295	K	

### Sampler 1174 Calibration Curve Site: Tuen Mun CWSF (TM1a)

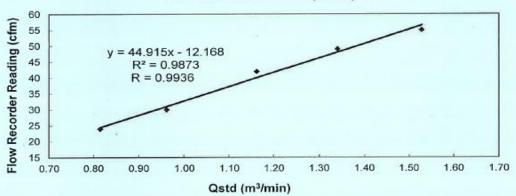

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by:

MAK, Kei Wai

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-15
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23



### **TEST REPORT**

### Calibration Report

of

### High Volume Air Sampler

Manufacturer

: Graseby GMW

Date of Calibration

24 June 2023

Serial No.

: 1174 (ET / EA / 003 / 08)

Calibration Due Date

: 23 August 2023

Method


Five-point calibration by using standard calibration kit Tisch TE-5025A refer to the Operations

Manual

Results

Flow recorder reading (cfm)	53	47	39	29	22
Qstd (Actual flow rate, m3/min)	1.51	1.30	1.13	0.93	0.76
Pressure:	755.39 mm Hg	Temp.:	302	K	

### Sampler 1174 Calibration Curve Site: Tuen Mun CWSF (TM1a)

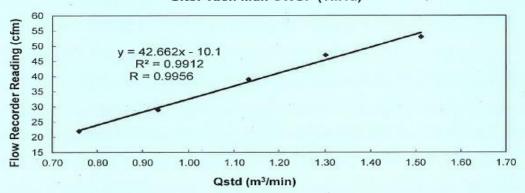

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration.

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable\* for use.

Calibrated by:

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



e D-16
# EMA2204/03/18
. 01



Date

Jul 23

### TEST REPORT

#### Calibration Report of High Volume Air Sampler

Manufacturer

: Graseby GMW

Date of Calibration

: 26 April 2023

Serial No.

: 1180 (ET/EA/003/04)

Calibration Due Date

: 25 June 2023

Method


Based on Operations Manual for the 5-point calibration using standard calibration kit

manufactured by Tisch TE-5025 A

Results

Flow recorder rea	ading (cfm)		54	47	43	32	24
Qstd (Actual flow	rate, m3/min)		1.63	1.50	1.32	1.12	0.83
Pressure:	761.01	mm Hg		Temp.:	295	K	

### Sampler 1180 Calibration Curve Site: Tuen Mun (TM-RA2)

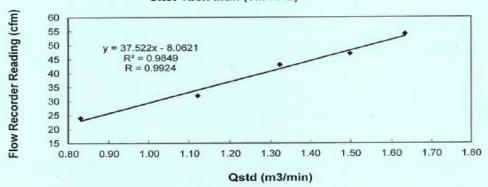

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / dees-not-comply\* with the specified requirements and is deemed acceptable\* / unacceptable \* for use.

Calibrated by:

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-17
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01



/eristrong industrial Centre 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

Date

Jul 23

### TEST REPORT

#### Calibration Report of High Volume Air Sampler

Manufacturer

: Graseby GMW

Date of Calibration

: 24 June 2023

Serial No.

1180 (ET/EA/003/04)

Calibration Due Date : 23 August 2023

Method


Based on Operations Manual for the 5-point calibration using standard calibration kit

manufactured by Tisch TE-5025 A

Results

Flow recorder rea	iding (cfm)		51	44	40	31	22
Qstd (Actual flow	rate, m3/min)		1.59	1.46	1.27	1.07	0.77
Pressure:	755.39	mm Hg		Temp.:	302	K	

#### Sampler 1180 Calibration Curve Site: Tuen Mun (TM-RA2)

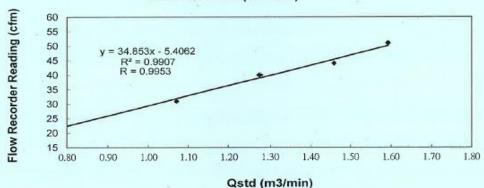

Acceptance Criteria: Correlation coefficient (r) of the calibration curve greater than 0.990 after a 5-point calibration

The high volume sampler complies\* / does not comply\* with the specified requirements and is deemed acceptable\* / unacceptable \* for use.

Calibrated by :

(Assistant Supervisor)

Checked by

LAU, Chi Leung

(Environmental Team Leader)



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	D-18
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
, <u>_</u>	Date	Jul 23



RECALIBRATION DUE DATE:

January 17, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: January 17, 2023

Calibration Model #: TE-5025A

Rootsmeter S/N: 438320

Ta: 294 Pa: 741.4 °K

Operator: Jim Tisch

Calibrator S/N: 4128

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4370	3.2	2.00
2	3	4	1	1.0170	6.4	4.00
3	5	6	1	0.9140	8.0	5.00
4	7	8	1	0.8640	8.8	5.50
5	9	10	1	0.7170	12.8	8.00

		Data Tabulat	ion		
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$ (y-axis)	Va	Qa (x-axis)	√∆H(Ta/Pa) (y-axis)
0.9846	0.6852	1.4063	0.9957	0.6929	0.8905
0.9803	0.9639	1.9888	0.9914	0.9748	1.2594
0.9782	1.0702	2.2235	0.9892	1.0823	1.4081
0.9771	1.1309	2.3321	0.9881	1.1437	1.4768
0.9718	1.3553	2.8126	0.9827	1.3706	1.7811
	m=	2.09676		m=	1.31296
QSTD	b=	-0.03027	QA	b=	-0.01917
	r=	0.99991	~.	r=	0.99991

Calculati	ons	
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=]ΔVol((Pa-ΔP)/Pa)	
Qstd= Vstd/∆Time	Qa= Va/ΔTime	
For subsequent flow i	rate calculations:	
Qstd= $1/m \left( \sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)} \right) - b$	$Qa = 1/m \left( \left( \sqrt{\Delta H \left( Ta/Pa \right)} \right) - b \right)$	

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

### RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002 www.tisch-env.com

TOLL FREE: (877)263-7610 FAX: (513)467-9009

FAX: (513)467-9009



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	E-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emarchoport	Date	Jul 23

### APPENDIX E – METHODOLOGY FOR CORRELATION CALCULATION BETWEEN POTABLE LASER DUST METER AND HIGH-VOLUME SAMPLER



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	E-2
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monany Emarkitopoli	Date	Jul 23

### Correlation between Portable laser dusty meter and High-volume Sampler Methodology

Correlation results between the direct reading meter and High-Volume Sampler

High - Volume Sampler Calibration

The specification, a sample of calibration certificate and certificate of comparison check with High volume sampler of the proposed air quality monitoring equipment listed in Table 2.1 are attached in appendix.

The High-Volume air sampler calibration procedure based on the requirement of manufacturer is shown below.

- a. Disconnect the sampler motor from the mass flow controller and connect the motor to a stable AC power source.
- b. Mount the calibrator orifice and top loading adapter plate to the sampler. A sampling filter is generally not used during this procedure. Tighten the top loading adapter hold down nuts securely to ensure that no air leaks are present.
- c. Allow the sampler motor to warm up to its normal operating temperature
- d. (approximately 10-15 minutes).
- e. Conduct a leak test by covering the hole(s) on top of the orifice and pressure tap on the orifice with your hands. Listen for a high-pitched squealing sound made by escaping air. If this sound is heard, a leak is present and the top loading adapter hold-down nuts need to be re-tightened. If the sound is lower, the leak is near one of the other gaskets in the system. Avoid running the sampler for longer than 30 seconds at a time with the orifice blocked to avoid overheating the motor. Do not perform this leak test procedure with a manometer connected to the side tap on the calibration orifice or the blower motor. Liquid from the manometer could be drawn into the system and cause motor damage
- f. Connect one side of a water manometer to the pressure tap on the side of the orifice with a rubber vacuum tube. Leave the opposite side of the manometer open to the atmosphere. Note: Both valves on the manometer have to be open for the liquid to flow freely. One side of the 'U' tube goes up the other goes down; add together for the "H2O reading.
- g. A manometer must be held vertically to ensure accurate readings. Tapping the backside of the continuous flow recorder will help to center the pen and provide accurate readings. When using a variable orifice, five flow rates are achieved in this step by adjusting the knob on the variable orifice to five different positions and taking five different reading.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	E-3
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emarcroport	Date	Jul 23

- h. Record the ambient air temperature, the ambient barometric pressure, the sampler serial number, the orifice s/n, the orifice slope and intercept with date last certified, today's date, site location and the operators initial on the attached blank calibration sheet.
- i. An example of a Lead (or TSP) Sampler Calibration Data Sheet has been attached with data filled in from a typical calibration. This includes the transfer standard orifice calibration relationship which was taken from the Orifice Calibration Worksheet that accompanies the calibrator orifice.

Disconnect the sampler motor from its power source and remove the orifice and top loading adapter plate. Re-connect the sampler motor to the electronic mass flow controller.

Since this calibration is for a TSP sampler, the slope and intercept for this orifice uses standard flows rather than actual flows and is taken from the Q standard section of the Orifice Calibration Worksheet. The Q actual flows are only used when calibrating a PM-10 sampler.

The five orifice manometer readings taken during the calibration have been recorded in the column on the data worksheet titled Orifice "H2O. The five continuous flow recorder readings taken during the calibration have been recorded under the column titled I chart.

The orifice manometer readings need to be converted to the standard air flows they represent using the following equation:

 $Qstd = 1/m[Sqrt((H_20)(Pa/760)(298/Ta))-b]$ 

where:

Qstd = actual flow rate as indicated by the calibrator orifice, m<sup>3</sup>/min

H<sub>2</sub>O = orifice manometer reading during calibration, "H<sub>2</sub>O

Ta = ambient temperature during calibration, K ( $K = 273 + {}^{\circ}C$ )

298 = standard temperature, a constant that never changes, K

Pa = ambient barometric pressure during calibration, mm Hg

760 = standard barometric pressure, a constant that never changes, mm Hg

m = Qstandard slope of orifice calibration relationship

b = *Qstandard intercept of orifice* calibration relationship.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	E-4
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Linux Report	Date	Jul 23

Once these standard flow rates have been determined for each of the five run points, they are recorded in the column titled Qstd and are represented in cubic meters per minute.

The continuous flow recorder readings taken during the calibration need to be corrected to the current meteorological conditions using the following equation:

$$IC = I[Sqrt((Pa/760)(298/Ta))]$$

where:

IC = continuous flow recorder readings corrected to current Ta and Pa

I = continuous flow recorder readings during calibration

Pa = ambient barometric pressure during calibration, mm Hg.

760 = standard barometric pressure, a constant that never changes, mm Hg

Ta = ambient temperature during calibration, K (K = 273 + °C)

298 = standard temperature, a constant that never changes, K

After each of the continuous flow recorder readings have been corrected, they are recorded in the column titled IC (corrected).

Using Qstd and IC (or FLOW (corrected)) as the x and y axis respectively, a slope, intercept, and correlation coefficient can be calculated using the least squares regression method. The correlation coefficient should never be less than 0.990 after a five-point calibration. A coefficient below .990 indicates a calibration that is not linear, and the calibration should be performed again. If this occurs, it is most likely the result of an air leak during the calibration or high wind speed during the calibration procedure.

The equations for determining the slope (m) and intercept (b) are as follows:

m=
$$\frac{\sum xy - n}{\sum xy - n}$$

$$\frac{(\sum x)^2}{\sum x^2 - n}; \quad b = y - mx$$

The equation for the coefficient of correlation (r) is as follows:



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	E-5
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monany _mark topolit	Date	Jul 23

$$\mathbf{r} = \sum xy - \frac{(\sum x)(\sum y)}{n}$$

$$\sqrt{\sum x^2 - \frac{(\sum x)^2}{n}} \left[\sum y^2 - \frac{(\sum y)^2}{n}\right]$$

where: n = number of observations $\sum = sum of$ 

The acceptable operating flow range of a TSP sampler is 1.1 to 1.7 m3/min (39 to 60 CFM). Looking at the worksheet column Qstd(see page 38), the flow rates that are within this range can be identified along with the chart reading (I) that represents them. For instance, if you wanted to set this sampler at 1.265 m3/min (44.67 CFM) (Make sure the mass flow controller is plugged in and a filter is in place) you would turn the Flow Adjustment screw until the continuous flow recorder read 37 on the chart. By making sure that the sampler is operating at a chart reading (or manometer reading) that is within the acceptable range, it can be assumed that valid TSP data is being collected.

A calibration that has a correlation coefficient of less than .990 is not considered linear and should be re-calibrated. Therefore, if r < 0.990, return all the points or only the point with the greatest deviation and the recalculate.

The 24-hour TSP levels to be measured by direct reading methods, utilising portable Laser Particle Photometer Monitors (Sibata Model LD-3B), in place of High-Volume Sampler (HVS) if HVS experience difficulties in operation during monitoring. It is demonstrated by the previous project experiences, that 24-hour TSP monitoring results collected by direct reading method are comparable to those produced by the high-volume sampling method, to indicate short event impacts. The projects utilising the collection of 24-hour TSP levels data by direct reading methods are shown below.

### Project Reference for utilising the collection of 24-hour TSP levels data by direct reading methods

Project Contract Number	Location	Status
NDO 03/2018	Road Widening and Retrofitting Noise Barriers on	On-going
	Tai Po Road (Sha Tin Section)	



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	E-6
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emark Report	Date	Jul 23

NDO 14/2018	Advance and First Stage Works of Kwu Tung North	On-going
	and Fanling North New Development Areas	

Calculation of the value of 24-hour TSP concentration is given by the average of 24 calculated 1-hour TSP concentration, where the calculated 1-hr TSP concentration is given by the product of the direct reading and the K-factor based on the correlation results between the direct reading meter and High-Volume Sampler.

The correlation results between the direct reading meter and High-Volume Sampler shall be review with bimonthly internal calibration. To maintain the correlation with two sets of data (monitoring data from HVS and monitoring data from Portable Laser Particle Photometer Monitors) bimonthly internal calculated are strongly linked together two sets of data.

To protect the dust meter from being damaged and to operate without disturbances or nuisance, temporary barriers shall be erected around the monitoring equipment during the monitoring period. Temporary barriers will be placed approx. 0.5m away from the dust meter.

### Maintenance/ Calibration for the High-Volume Sampler (HVS) being correlation

The HVS shall be calibrated bimonthly in accordance to the specification in the manufacturer's manual. The calibration certificates shall be available to the IEC for checking upon request. The validity and accuracy of the HVS shall also be tested against the result by the TE-5025A Calibration Kit periodically, Details of Calibration Cert and Specification for HVS – Graseby GMW and HVS- Calibration Kit TE-5025A are given in Appendix 2-1 and Appendix 2-3.

Graseby GMW is chosen as the HVS for 24-hour TSP monitoring and Tisch TE – 5025A is chosen as the HVS Calibration-Kit for HVS calibration.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	F-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

### APPENDIX F - AIR QUALITY AND NOISE IMPACT MONITORING SCHEDULE



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	F-2
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly =max rroport		Jul 23

## 2023 June Air Quality and Noise Impact Monitoring Schedule

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
28-May		30-May	31-May	1-Jun	2-Jun	3-Jun
			1 hr TSP x 3 24 hr TSP Noise (30 mins)			
4-Jun	5-Jun	6-Jun	7-Jun	8-Jun	9-Jun	10-Jun
		1 hr TSP x 3 24 hr TSP Noise (30 mins)				
11-Jun	12-Jun	13-Jun	14-Jun	15-Jun	16-Jun	17-Jun
	1 hr TSP x 3 24 hr TSP Noise (30 mins)				1 hr TSP x 3 24 hr TSP	
18-Jun	19-Jun	20-Jun	21-Jun	22-Jun	23-Jun	24-Jun
			1 hr TSP x 3 24 hr TSP Noise (30 mins)			
25-Jun	26-Jun	27-Jun	28-Jun	29-Jun	30-Jun	1-Jul
		1 hr TSP x 3 24 hr TSP Noise (30 mins)				



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	F-3
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emarchoport		Jul 23

## 2023 July Air Quality and Noise Impact Monitoring Schedule

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
25-Jun	26-Jun	27-Jun	28-Jun	29-Jun	30-Jun	1-Jul
		1 hr TSP x 3 24 hr TSP Noise (30 mins)				
2-541	1 hr TSP x 3 24 hr TSP Noise (30 mins)	4-Jul	5-Jul	6-Jul	1 hr TSP x 3 24 hr TSP	8-Jul
9-Jul	10-Jul	11-Jul	12-Jul	13-Jul	14-Jul	15-Jul
				1 hr TSP x 3 24 hr TSP Noise (30 mins)		
16-Jul	17-Jul	18-Jul	19-Jul	20-Jul	21-Jul	22-Jul
			1 hr TSP x 3 24 hr TSP Noise (30 mins)			
29-Jul	24-Jul	1 hr TSP x 3 24 hr TSP Noise (30 mins)	26-Jul	27-Jul	28-Jul	29-Jul
30-Jul	31-Jul 1 hr TSP x 3 24 hr TSP Noise (30 mins)	1-Aug	2-Aug	3-Aug	4-Aug	S-Aug



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	G-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## APPENDIX G - AIR QUALITY MONITORING RESULT



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	G-2
EF-310/2010 - FOIT Sheller Sewerage, Stages - Sewerage Works at FO 101 O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## 2023 June 1-hour Monitoring Data

Monitoring Location: AMS1N

				1-hour TSP Monitoring		
Date	Weather		Start Time	Concentration (µg/m³)	Average Concentration (µg/m³)	
	Cloudy	1st hr	10:46	48.0	47.0	
6-Jun-23	Cloudy	2nd hr	13:46	46.0	47.3	
		3rd hr	14:46	48.0		
	Fine	1st hr	9:45	34.0	33.7	
12-Jun-23	rine	2nd hr	10:45	33.0	33.7	
		3rd hr	13:15	34.0		
	Cloudy	1st hr	9:30	30.0	28.7	
16-Jun-23	Cloudy	2nd hr	10:30	28.0	20.7	
		3rd hr	13:00	28.0		
	Fine	1st hr	9:40	30.0	31.3	
21-Jun-23	FILLE	2nd hr	10:40	33.0	31.3	
		3rd hr	13:08	31.0		
		1st hr	10:36	53.0		
27-Jun-23	Cloudy	2nd hr	13:36	59.0	58.7	
		3rd hr	14:36	64.0		
		·		Average:	39.9	
				Action Level:	319	
				Limit Level:	500	



ED 540/0040 Part Ohaltan Cannanana Otama Cannanana Washa at Ba Tai O		G-3
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
,	Date	Jul 23

## 2023 June 1-hour Monitoring Data

Monitoring Location: AMS2N1

				1-hour TSP Monitoring		
Date	Weather		Start Time	Concentration (µg/m³)	Average Concentration (µg/m³)	
	Claudy	1st hr	10:41	73.0	70.7	
6-Jun-23	Cloudy	2nd hr	13:41	70.0	72.7	
		3rd hr	14:41	75.0		
	Fine	1st hr	9:50	52.0	53.3	
12-Jun-23	rille	2nd hr	10:50	54.0	55.5	
		3rd hr	13:10	54.0		
	Cloudy	1st hr	9:35	44.0	44.7	
16-Jun-23	Cloudy	2nd hr	10:35	46.0	44.7	
		3rd hr	13:05	44.0		
	Fine	1st hr	9:45	31.0	32.3	
21-Jun-23	FIIIE	2nd hr	10:45	31.0	32.3	
		3rd hr	13:06	35.0		
		1st hr	10:42	145.0		
27-Jun-23	un-23 Cloudy	2nd hr	13:42	155.0	149.0	
		3rd hr	14:42	147.0		
				Average:	70.4	
				Action Level:	279	
				Limit Level:	500	



ED 540/0040 Dart Obaltan Carrage Clause Construe Warks at Da Tai O		G-4
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## 2023 June 1-hour Monitoring Data

Monitoring Location: AMS3N

				1-hour TSP Monitoring		
Date	Weather		Start Time	Concentration (µg/m³)	Average Concentration (µg/m³)	
	Claudy	1st hr	10:34	39.0	42.0	
6-Jun-23	Cloudy	2nd hr	13:34	45.0	42.0	
		3rd hr	14:34	42.0		
	Fine	1st hr	10:00	30.0	30.7	
12-Jun-23	rille	2nd hr	11:00	31.0	30.7	
		3rd hr	13:05	31.0		
	Cloudy	1st hr	9:40	25.0	23.0	
16-Jun-23	Cloudy	2nd hr	10:40	22.0		
		3rd hr	13:10	22.0		
	Fine	1st hr	9:50	25.0	24.7	
21-Jun-23	FIIIE	2nd hr	10:50	24.0	24.7	
		3rd hr	13:03	25.0		
		1st hr	10:48	82.0		
27-Jun-23	Cloudy	2nd hr	13:48	75.0	80.0	
		3rd hr	14:48	83.0		
				Average:	40.1	
				Action Level:	303	
				Limit Level:	500	



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	G-5
EF-310/2010 - FOIT Sheller Sewerage, Stages - Sewerage Works at FO TOI O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23


## 2023 June 1-hour Monitoring Data

Monitoring Location: AMS4N

				1-hour TSP Monitoring		
Date	Weather		Start Time	Concentration (µg/m³)	Average Concentration (µg/m³)	
	Claudy	1st hr	10:27	41.0	42.2	
6-Jun-23	Cloudy	2nd hr	13:27	43.0	43.3	
		3rd hr	14:27	46.0		
	Fine	1st hr	9:55	32.0	34.7	
12-Jun-23	FILLE	2nd hr	10:55	36.0	34.7	
		3rd hr	13:00	36.0		
	Cloudy	1st hr	9:45	27.0	28.3	
16-Jun-23	Cloudy	2nd hr	10:45	29.0	20.3	
		3rd hr	13:15	29.0		
	Fine	1st hr	9:42	25.0	27.0	
21-Jun-23	FILLE	2nd hr	10:42	27.0	27.0	
		3rd hr	13:00	29.0		
		1st hr	10:30	88.0		
27-Jun-23	Cloudy	2nd hr	13:30	107.0	97.3	
		3rd hr	14:30	97.0		
				Average:	46.1	
				Action Level:	278	
				Limit Level:	500	




ED 545/2046 Down Chalter Courseans Store 2 Courseans Works at De Toi O	Page	
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

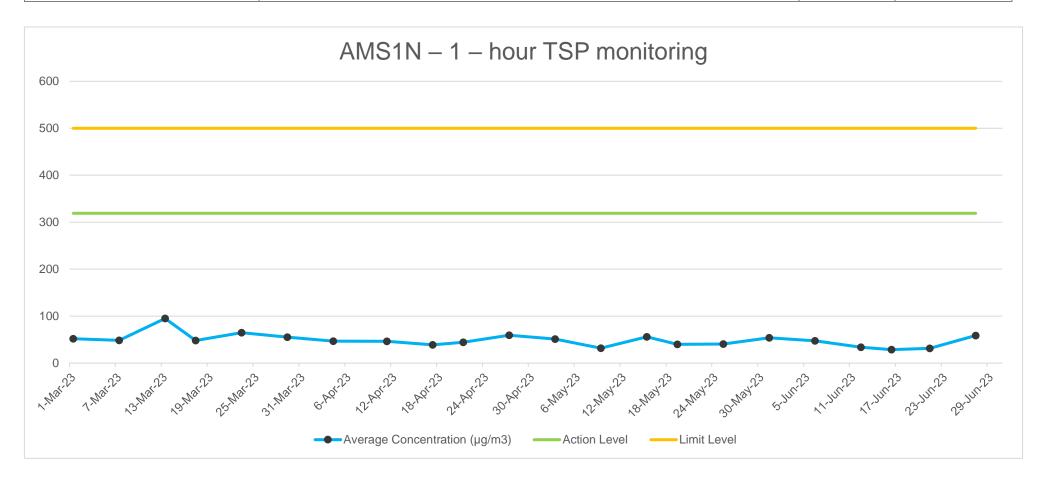




ED 516/2016 - Dort Shelter Sowerege Stage? - Sowerege Works at De Toi O	Page	G-7
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
, <u></u>	Date	Jul 23

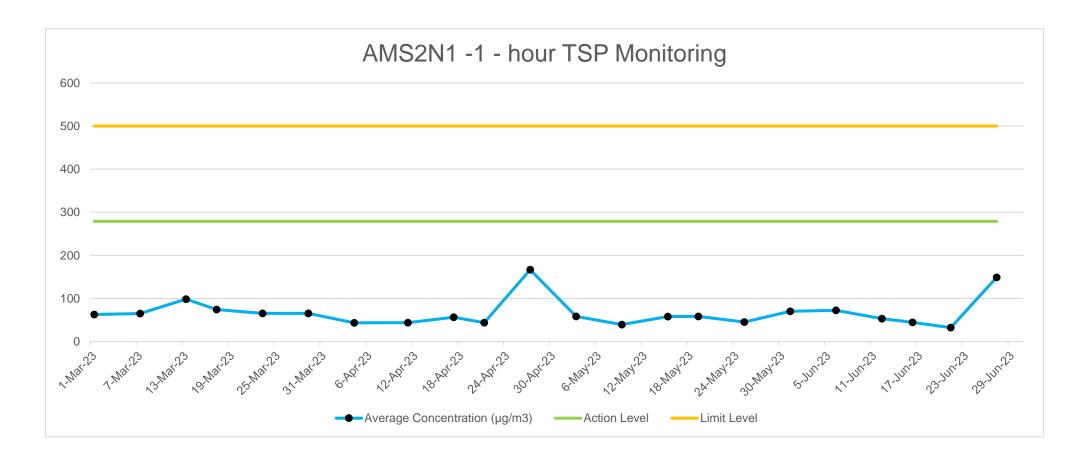




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	G-8
	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

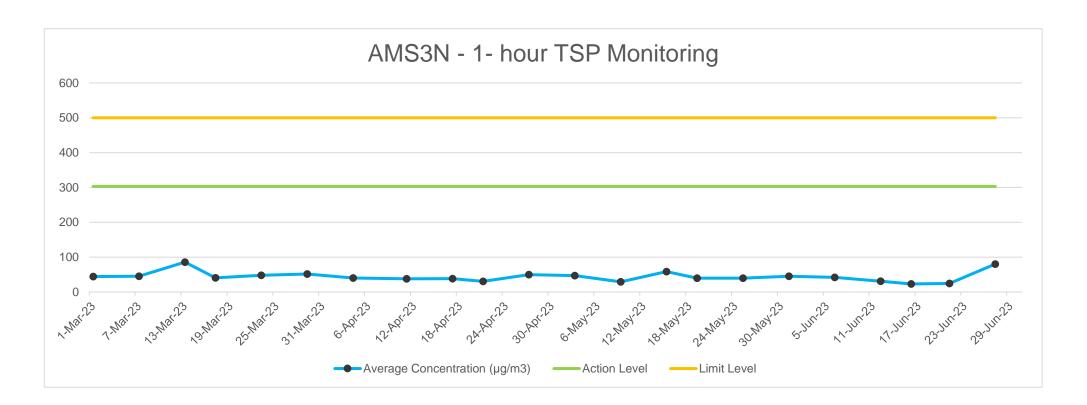



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	G-9
	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

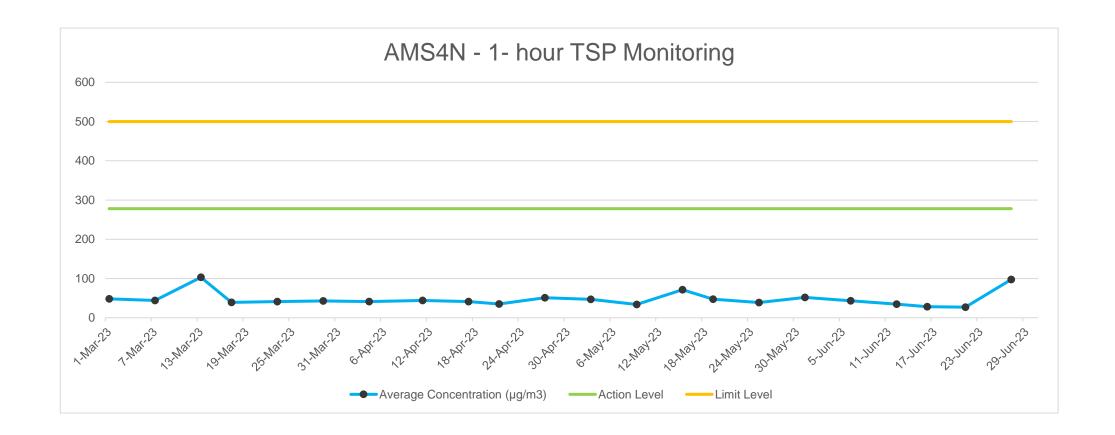

SGS	
'	

EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po		G-10
Toi Ó	Ref#	EMA2204/03/18
Toi O  Monthly EM&A Report	Rev.	01
	Date	Jul 23

## 2023 June 24-hour Monitoring Data

Monitoring Location: AMS1N

Hour	6-Jun-23	12-Jun-23	16-Jun-23	21-Jun-23	27-Jun-23
1	34	25	19	19	54
2	39	24	18	20	51
3	35	26	17	22	45
4	36	25	19	19	58
5	32	27	20	20	60
6	29	28	21	19	57
7	25	28	21	15	49
8	25	27	20	15	50
9	26	26	20	15	37
10	25	25	19	19	39
11	31	24	19	18	38
12	28	26	22	19	42
13	28	27	22	20	46
14	28	27	20	19	41
15	28	28	20	17	36
16	26	24	18	16	44
17	27	25	18	16	48
18	28	22	17	16	52
19	29	23	17	18	63
20	25	22	19	19	59
21	27	21	19	18	69
22	32	23	20	18	62
23	34	23	21	19	53
24	35	22	21	20	58
Average:	30	25	19	18	50
24-hr TSP					
(μg/m³; with	42	36	28	27	67
correlation(x)					
Action Level:	153		ı	ı	
Limit Level:	260				

	EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po	Page	G-11
GGG	Toi O	Ref#	EMA2204/03/18
909	Monthly EM&A Report	Rev.	01
		Date	Jul 23

## 2023 June 24-hour Monitoring Data

Monitoring Location: AMS2N1

Hour	6-Jun-23	12-Jun-23	16-Jun-23	21-Jun-23	27-Jun-23
1	32	27	23	15	74
2	37	27	24	16	81
3	38	28	22	20	73
4	35	28	22	19	76
5	31	26	23	16	78
6	33	28	23	16	78
7	30	27	24	14	77
8	32	28	24	13	84
9	33	29	22	14	85
10	34	29	20	15	81
11	29	28	29	17	79
12	32	27	28	16	73
13	32	25	21	16	76
14	31	24	21	16	81
15	33	23	20	15	82
16	35	26	22	14	88
17	34	26	23	15	84
18	32	23	20	16	79
19	35	24	20	15	76
20	36	23	21	15	78
21	37	22	21	16	78
22	37	25	20	17	77
23	40	24	19	19	83
24	39	24	18	20	87
Average:	34	27	22	16	80
24-hr TSP					
(µg/m³; with	68	54	44	33	157
correlation(x)					
Action Level:	179		1	1	
Limit Level:	260	1			

	SGS	ı
	UUU	
- 1		

EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po	Page	G-12
Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## 2023 June 24-hour Monitoring Data

Monitoring Location: AMS3N

Hour	6-Jun-23	12-Jun-23	16-Jun-23	21-Jun-23	27-Jun-23
1	25	21	17	19	53
2	23	22	17	21	55
3	22	23	19	21	55
4	22	23	19	18	59
5	26	24	20	20	62
6	26	24	20	21	65
7	28	25	21	15	63
8	26	25	21	14	59
9	26	26	20	16	56
10	26	24	18	20	60
11	24	24	18	20	57
12	25	23	20	19	56
13	24	22	21	21	61
14	27	21	21	19	54
15	26	24	22	16	54
16	26	24	22	15	50
17	24	23	19	16	47
18	25	25	19	17	41
19	29	26	20	17	43
20	24	24	20	19	44
21	23	23	21	17	48
22	22	23	21	18	43
23	27	24	20	18	52
24	25	25	19	17	50
Average:	25	24	19	18	54
24-hr TSP					
(µg/m³; with	34	32	25	24	75
correlation(x)					
Action Level:	158		1	1	L
Limit Level:	260	1			



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po		G-13
Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
•	Date	Jul 23


## 2023 June 24-hour Monitoring Data

Monitoring Location: AMS4N

Hour	6-Jun-23	12-Jun-23	16-Jun-23	21-Jun-23	27-Jun-23
1	28	23	18	18	67
2	29	24	18	20	64
3	32	24	17	21	61
4	31	22	17	21	63
5	29	22	20	20	56
6	28	23	20	19	53
7	28	25	18	17	61
8	29	24	17	16	60
9	26	22	17	17	48
10	28	26	21	17	46
11	25	25	21	19	49
12	28	26	20	18	50
13	28	26	22	18	54
14	27	24	22	19	52
15	25	24	20	18	47
16	24	23	20	15	48
17	25	24	18	16	48
18	29	24	19	16	49
19	28	25	19	16	54
20	27	25	20	18	53
21	25	23	20	18	45
22	25	24	21	20	51
23	27	24	20	19	54
24	28	24	18	19	59
Average:	27	24	19	18	54
24-hr TSP					
μg/m³; with	41	36	27	25	88
orrelation(x)					
Action Level:	144			u .	1
Limit Level:	260				




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		G-14
		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23

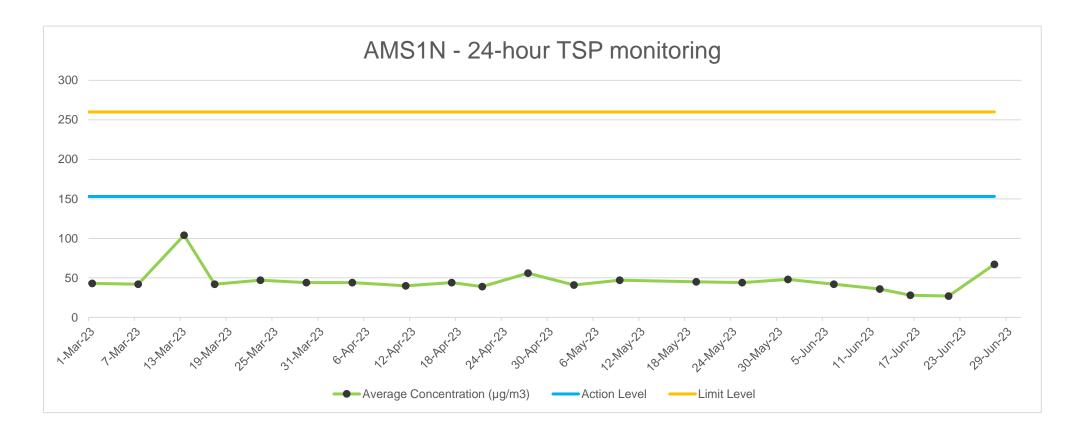




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		G-15
		EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23

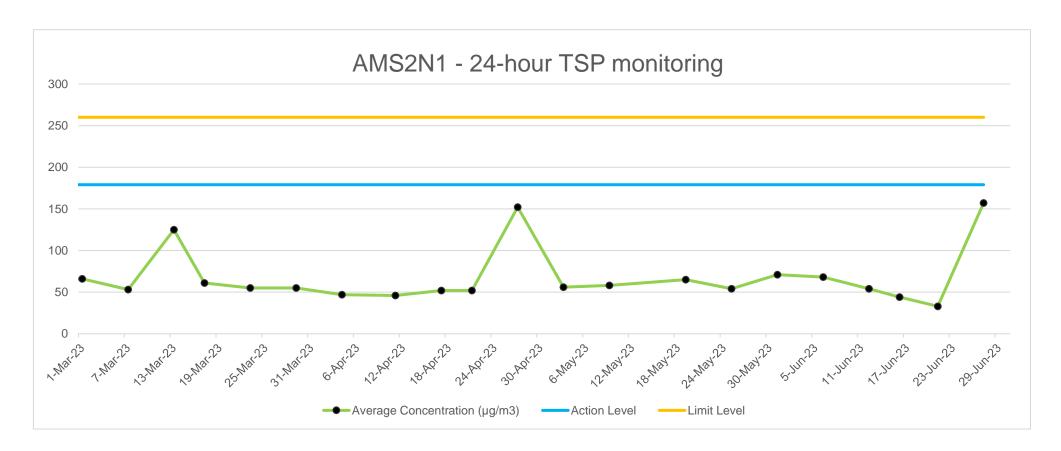




EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		G-16
		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23

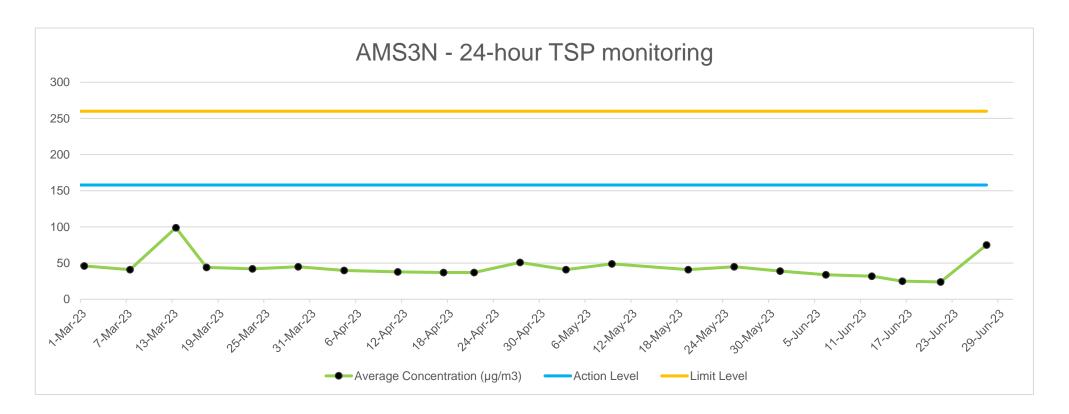



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		G-17
		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23

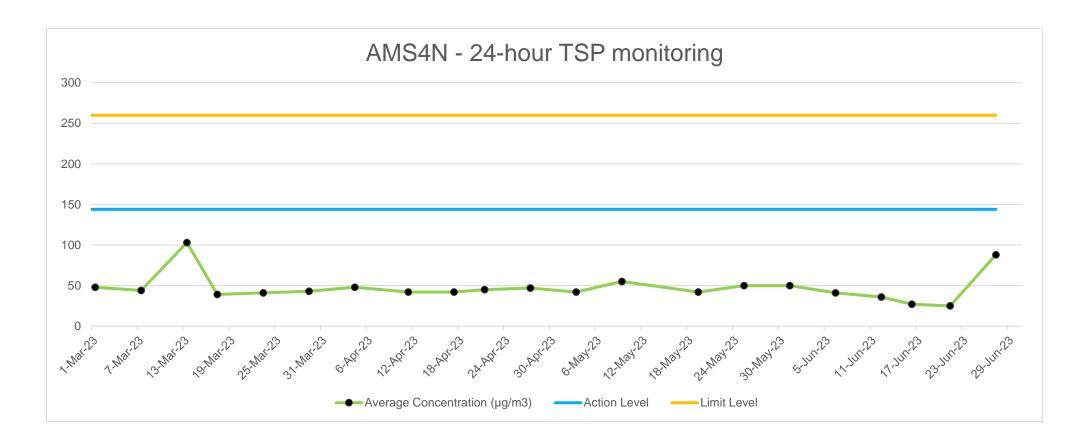



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		H-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## APPENDIX H – EVENT AND ACTION PLAN



Page	H-2
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

## Monthly EM&A Report

## **AIR QUALITY MONITORING**

EVENT		A	CTION	
EVENI	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
Exceedance for one sample	<ol> <li>Repeat measurement to confirm findings;</li> <li>If exceedance is confirmed, inform the Contractor, IEC and ER;</li> <li>Identify source(s), investigate the causes of exceedance and propose remedial measures; and</li> <li>Increase monitoring frequency.</li> </ol>	Check monitoring data submitted by the ET;     Check Contractor's working method; and     Discuss with ET, ER and Contractor on possible remedial measures     Review and advise the ET and ER on the effectiveness of the proposed remedial measures.	Confirm receipt of notification of exceedance in writing.	Identify source(s), investigat the causes of exceedance and propose remedia measures;     Implement remedia measures; and     Amend working method agreed with the ER a appropriate.
Exceedance for two or more consecutive samples	<ol> <li>Repeat measurements to confirm findings;</li> <li>If exceedance is confirmed, inform Contractor, IEC and ER;</li> <li>Identify source(s), investigate the causes of exceedance and propose remedial measures;</li> <li>Increase monitoring frequency to daily;</li> <li>Advise the Contractor and ER on the effectiveness of the proposed remedial measures;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> </ol>	<ol> <li>Check monitoring data submitted by the ET;</li> <li>Check Contractor's working method; and</li> <li>Discuss with ET, ER and Contractor on possible remedial measures;</li> <li>Review and advise the ET and ER on the effectiveness of the proposed remedial measures; and</li> <li>Supervise Implementation of remedial measures.</li> </ol>	Confirm receipt of notification of exceedance in writing;     In consultation with the ET and IEC agree with the Contractor on the remedial measures to be implemented; and     Supervise implementation of remedial measures	Identify source(s) and investigate the causes of exceedance;     Submit proposals for remedial measures to the ER, ET and IEC within three working days of notification for agreement;     Implement the agreed proposals; and     Amend proposal as appropriate.



Monthly EM&A Report

•	Page	H-3
0	Ref#	EMA2204/03/18
	Rev.	01
	Date	Jul 23

EVENT	ACTION			
EVENT	FT  7. If exceedance continues, arrange meeting with Contractor, IEC and ER to discuss the remedial measures to be taken; and  8. If exceedance stops, cease additional monitoring.	IEC	ER	CONTRACTOR
LIMIT LEVEL				
Exceedance for one sample	<ol> <li>Repeat measurement to confirm findings;</li> <li>If exceedance is confirmed, inform the Contractor, IEC, EPD and ER;</li> <li>Identify source(s), investigate the causes of exceedance and propose remedial;</li> <li>Increase monitoring frequency to daily; and</li> <li>Discuss with the ER, IEC and Contractor on the remedial measures and assess effectiveness.</li> </ol>	<ol> <li>Check monitoring data submitted by the ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with the ET, ER and Contractor on possible remedial measures;</li> <li>Review and advise the ET and ER on the effectiveness of the proposed remedial measures; and</li> <li>Supervise implementation of remedial measures.</li> </ol>	Confirm receipt of notification of exceedance in writing;     Review and agree on the remedial measures proposed by the Contractor; and     Ensure remedial measures properly implemented.	<ol> <li>Identify source(s) and investigate the causes of exceedance;</li> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial measures to ER, ET and IEC within three working days of notification for agreement;</li> <li>Implement the agreed proposals; and</li> <li>Amend proposal if appropriate.</li> </ol>
Exceedance for two or more consecutive samples	Repeat measurement to confirm findings;     If exceedance is confirmed, inform IEC, ER, Contractor and EPD;     Identify source(s), investigate the causes of	Check monitoring data submitted by the ET;     Discuss amongst ER, ET, and Contractor on the potential remedial actions;	Confirm receipt of notification of exceedance in writing;     In consultation with the ET and IEC, agree with the Contractor on the remedial measures to be implemented;	Identify source(s) and investigate the causes of exceedance;     Take immediate action to avoid further exceedance;     Submit proposals for remedial measures to the



# Page H-4 Ref# EMA2204/03/18 Rev. 01 Date Jul 23

## Monthly EM&A Report

EVENT	ACTION					
EVENT	ET exceedance and propose remedial measures; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine	IEC 3. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; and 4. Supervise the	ER 3. Supervise the implementation of remedial measures; and 4. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop	CONTRACTOR  ER, IEC and ET within three working days of notification for agreement;  4. Implement the agreed proposals;  5. Revise and resubmit proposals if problem still not		
	possible mitigation to be implemented; 6. Arrange meeting with IEC and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; and 8. If exceedance stops, cease additional monitoring.	implementation of remedial measures.	that portion of work until the exceedance is abated.	under control; and 6. Stop the relevant portion of works as determined by the ER until the exceedance is abated.		

Note: ET – Environmental Team; ER – Engineer's Representative; IEC – Independent Environmental Checker



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page H-5 Ref# EMA2204/03/18 Rev. 01 Date Jul 23

## **NOISE IMPACT MONITORING**

Event	Action					
	ET	IEC	ER	CONTRACTOR		
Action Level	1. Notify IEC, ER and Contractor of	1. Review the analysed results	1. Confirm receipt of notification of	Submit noise mitigation proposals to		
	exceedance;	submitted by the ET;	failure in writing;	ER with copy to ET and IEC;		
	2. Identify source	2. Review the proposed remedial	2. Notify Contractor;	Implement noise mitigation proposals.		
	3. Investigate the causes of	measures by the Contractor and advise	3. Require Contractor to propose			
	exceedance and propose remedial	the ER accordingly;	remedial measures for the analysed			
	measures;	3. Supervise the implementation of	noise problem;			
	4. Report the results of investigation to	remedial measures.	4. Ensure remedial measures are			
	the IEC, ER and Contractor;		properly implemented			
	5. Discuss with the IEC, ER and					
	Contractor and formulate remedial					
	measures;					
	6. Increase monitoring frequency to					
	check mitigation effectiveness					



## Monthly EM&A Report

Page	H-6
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

Event	Action				
	ET	IEC	ER	CONTRACTOR	
Limit Level					
	1. Inform IEC, ER, EPD and Contractor;	1. Discuss amongst ER, ET, and	Confirm receipt of notification of failure in	1. Take immediate action to avoid further	
	2. Identify source;	Contractor on the potential remedial	writing;	exceedance;	
	3. Repeat measurements to confirm findings;	actions;	2. Notify Contractor;	2. Submit proposals for remedial actions to ER	
	4. Increase monitoring frequency;	2. Review Contractor's remedial	3. Require Contractor to propose remedial	with copy to ET and IEC within 3 working days of	
	5. Carry out analysis of Contractor's working	actions whenever necessary to	measures for the analyzed noise problem;	notification;	
	procedures to determine possible mitigation to	assure their effectiveness and advise	4. Ensure remedial measures are properly	3. Implement the agreed proposals;	
	be implemented;	the ER accordingly;	implemented;	4. Resubmit proposals if problem still not under	
	6. Inform IEC, ER and EPD the causes and	3. Supervise the implementation of	5. If exceedance continues, investigate what	control;	
	actions taken for the exceedances;	remedial measures.	portion of the work is responsible and instruct	5. Terminate the relevant portion of works as	
	7. Assess effectiveness of Contractor's remedial		the Contractor to terminate that portion of	determined by the ER until the exceedance	
	actions and keep IEC, EPD and ER informed		work until the exceedance ceases.	ceases.	
	of the results;				
	8. If exceedance stops, cease additional				
	monitoring.				



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		I-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23

## **APPENDIX I - NOISE MONITORING EQUIPMENT CALIBRATION CERTIFICATES**



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		I-2
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.



Form Q/AS/C/02 Issue 1(1/4) [02/22]

2

#### Calibration Certificate

Certificate No.

: CSA27669

Page

: 1 of

Information Provided by Customer

: ETS - Testconsult Limited

Address

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

Information of Unit-under-test (UUT)

Description

Sound Level Calibrator

Manufacturer Type

RION

NC-73

Equipment I.D. Serial No.

: ET/EN/002/01

: 10196943

Laboratory Information

Lab. Ref. No. Date of Calibration Date of Issue

: Q/CAL/22/9442/I

7-Nov-2022

10-Nov-2022

Procedure Date of Receipt : CQS/002/A

Calibration Location

: 1-Nov-2022 Calibration Laboratory

Calibration Condition

Ambient Temperature : (20±3) °C

Stabilizing Time : 30 minutes

: (1000±5) hPa

Ambient Pressure

Relative Humidity

: (50±20) %

Sampling

: As received

## Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Measuring Amplifier, ET/2702/01/01
- Signal generator, ET/2503/01
- Reference Oscilloscope, ET/2502/01

### Calibration specification

To perform the calibration of sound level calibrator

### Calibration result

The results are detailed on the subsequent pages.

#### Remarks

The calibration results apply to the particular unit-under-test only.

- The values given in this calibration certificate only to the values measureed at the time of test & any under not include allowance for the equipment long term drift, varifications with environmental changes, vibrator and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measure

Calibrated By:

Tommy TAM & Tony MA (Technician)

Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards, This report shall not be reproduced unless with prior written approval from this laboratory.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage		I-3
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre 34-36 Au Pul Wan Street, Fo Tan, Hong Kong

T: +852 2896 8318 F: +852 2895 3944 E: eti@ets-testconsulf.com W: www.ets-testconsulf.com



## **Calibration Certificate**

Certificate No. : CSA27669

Page: 2 of 2

#### Calibration Result:

1. Measured Sound Pressure Level:

No	minal Frequency (Hz)	Nominal Output Sound Pressure (dB)	Measured Output (dB)	Expanded Uncertatiny (dB)	Coverage Factor
	1000	94.0	94.0	0.13	2.0

2. Actual Output Frequency:

Nominal Frequency	Nominal Output	Measured Output (Hz)	Expanded	Coverage
(Hz)	Sound Pressure (dB)		Uncertatiny (Hz)	Factor
1000	94.0	981.906	0.13	2.0

#### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- Measured output are mean of three measurements.

\*\*\*End of certificate\*\*\*



## Monthly EM&A Report

Page	I-7
Ref#	EMA2204/03/18
Rev.	01

Jul 23



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

B/F Block B, Veristrong Industrial Centre 34-36 Au Pul Wan Street, Fe Tan, Hong Kong

Date

T: +852 2695 8318 F: +852 2695 3944 E: et@ets-testconsult.com W: www.ets-testconsult.com



Form Q/AS/C/01 Issue 1(1/7) [09/21]

#### Calibration Certificate

Certificate No.

: CSA27977

Page

: 1 of

3

#### Information Provided by Customer

Customer

: ETS - Testconsult Limited

Address

: B/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

## Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	
Туре	NL-52	UC-59	NH-25
Equipment I.D. no.	ET/EN/003/16	-	
Serial No.	00253765	07824	43795
Adaptors used	-	-	
Resolution	0.1 dB	S4	-

## Laboratory Information

Lab. Ref. No.

: Q/CAL/22/9824/I

Procedure

; CQS/001/A

Date of Calibration : 22-Nov-2022 : 23-Nov-2022 Date of Issue

Date of Receipt Calibration Location

: 16-Nov-2022 : Calibration Laboratory

Calibration Condition

Ambient Temperature : (20±3) °C

: 30 minutes

Relative Humidity

: (50±20) %

Stabilizing Time

Ambient Pressure : (1000±5) hPa Sampling : As received

## Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

### Calibration specification

To perform the calibration of linearity and frequency response by multi-function sound calibrator

#### Calibration result

The results are detailed on the subsequent pages.

## Remarks

- The calibration results apply to the particular unit-under-test only.
- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

Tommy TAM (Technician) Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards.

This report shall not be reproduced unless with prior written approval from this laboratory,



## Monthly EM&A Report

Page	I-7
Ref#	EMA2204/03/18
Rev.	01

Jul 23



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong

Date

T: +852 2695 6318 F: +652 2695 3944 E: etl@ets-testconsult.com W: www.ets-testconsult.com



#### Calibration Certificate

Certificate No. : CSA27977

Page : 2 of 3

### Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Range / Mode			Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	Self-cal	Before	94.0		94.3	0.3	0.13	2.0
	Range	30 to 130	104.0	1	104.3	0.3	0.13	2.0
	Mode	Fast	114.0		114.3	0.3	0.13	2.0
	Self-cal	After	94.0		94.0	0.0	0.13	2.0
A-Weighting	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
14	Mode	Fast	114.0		114.0	0.0	0,13	2.0
	Self-cal	After	94.0		94,0	0.0	0,13	2.0
	Range	30 to 130	104.0	1	104,0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0	1	94.0	0.0	0.13	2.0
	Range	30 to 130	104.0		104.0	0.0	0.13	2.0
C-Weighting	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-weighting	Self-cal	After	94.0		94,0	0.0	0,13	2.0
	Range	30 to 130	104.0	1.	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0		94,0	0,0	0,13	2,0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
Z-Weighting	Mode	Fast	114.0		114.0	0.0	0.13	2.0
z-weighting	Self-cal	After	94.0		94.0	0.0	0,13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0

## Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level
- Laboratory reference multi-function sound calibrator was used to adjust the "Self cal" reading of UUT,

1880



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	
Works at Po Toi O	

## **Monthly EM&A Report**

Page	I-8
Ref#	EMA2204/03/18
Rev.	01

Jul 23



# 東業德勤測試顧問有限公司 **ETS-TESTCONSULT LTD.**AF Block B, Veristrong Industrial Centre, 3d-36 AJ Pull Wan Street. Fo Tan, Hong Kong T:+802 2695 5394 E: et @ets-destconsult.com

Date



#### Calibration Certificate

Form Q/AS/C/01 leave 1(3/7) [05/21]

Certificate No. : CSA27977

Page : 3 of 3

#### Calibration Result;

Acoustic Sensitivity and Frequency Response:

2 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
			31.5	54.6	54.7	0.1	-30.4 +/- 2.0
			63	67.8	68.0	0.2	-26.2 +/- 1.5
			125	77.9	78.1	0.2	+16.1 +/- 1.5
			260	85.4	85,5	0.1	-8.6 +/- 1.4
			500	90.6	90.9	0.1	-3.2 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0+/-11
			2000	95.1	95.0	-0.1	+1.2 +/- 1,8
			4000	94.9	94.1	-0.8	+1,0+/-1,6
			8000	92.9	89.8	-3.1	-1,1 (+2,1; -3,1)
			12500	89.7	83.7	-6.0	-4.3 (+3.0 ; -5.0)
			16000	87.5	78.9	-10.6	-8.6 (+3.5 ; -17.0)

3 Frequency Response C-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 dass 1 Specification
			31.5	91.0	91,1	0.1	-3.0 +/- 2.0
			63	93.2	93,4	0.2	-0.8 +/- 1.5
			125	93.8	94.0	0.2	-0.2 +/- 1.5
			250	94,0	94.1	0.1	0.0+/-1.4
	Fast		500	94,0	94.1	0.1	0,0+/-1,4
30 to 130		94	1000 (Ref.)	94,0	94,0	0.0	0+4-1.1
			2000	93,7	93.6	-0.1	-0.2 =/- 1.6
			4000 93.1	92,3	-0.8	-0,8+/-1,6	
			6000	91,0	87.9	-3.1	-3,0 (+2,1;-3,1)
			12500	87.8	81,8	-6.0	-6.2 (+3.0; -6.0)
			18000	85.6	75.0	-10.6	-8.5 (+3.5 ; -17.0)

4 Frequency Response Z-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification	
			31.5	94.0	94,0	0.0	0,0 +/- 2,0	
			63	94,0	94.1	0,1	0.0 +/- 1.5	
			125	94.0	94.2	0,2	0.0 +/- 1.5	
			250	94.0	94.1	0,1	0.0+/-1.4	
			500	94.0	94.1	0,1	0.0 +/- 1.4	
30 to 130	Fast	94	1000 (Ref.)	94,0	94.0	0.0	0+/-1,1	
				2000	94.0	93.8	-0,2	0.0 */- 1.6
			4000	94.0	93,1	-0.8	0,0 +/- 1,6	
			8000	94.0	90,9	-3,1	0.0 (+2.1; -3,1)	
			12500	94,0	89,2	-5.8	0.0 (+3.0; -6.0)	
			16000	94.0	84.6	-9.4	0.0 (+3.5; -17.0)	

	Range (Hz)	(dB)	Range (Hz)	(dB)
	31,5	0.20	2000	0.13
	63	0.15	4000	0.13
94 dB	125	0.15	9000	0,14
94 GB	250	0.12	12500	0,16
1	500	0.12	16000	0.16
	1000	0 13		

- Manufacturer specification: IEC 61672 class 1
   Signal leval at 1000 Hz is set as indication of reference sound pressure level The uncertainty quoted is based on 95 % confidence level with coverage factor k=2 0.
  UUT reading are mean of three measurements.
  Deviation = UUT Reading - Reference Level

\*\*\*End of certificate\*\*\*



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	LF
Works at Po Toi O	R

## Monthly EM&A Report

Page	I-9
Ref#	EMA2204/03/18
Rev.	01

Jul 23



## 東業德勤測試顧問有限公司 S-TESTCONSULT LTD.

Date



Form Q/AS/C/01 Issue 1(1/7) [09/21]

3

## **Calibration Certificate**

Certificate No.

: CSA32590

: 1 of

Information Provided by Customer

Customer

: ETS - TESTCONSULT LIMITED

Address

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

## Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	-
Туре	NL-52	UC-59	NH-25
Equipment I.D. no.	ET/EN/003/18		*
Serial No.	00264520	09668	64646
Adaptors used		-	-
Resolution	0.1 dB	*	*

#### Laboratory Information

Lab. Ref. No. Date of Calibration

Date of Issue

: Q/CAL/23/2956/I : 19-Apr-2023 : 20-Apr-2023

Date of Receipt

: CQS/001/A

Calibration Location

: 13-Apr-2023 : Calibration Laboratory

## Calibration Condition

Ambient Temperature : (20 ± 3) \*C

Stabilizing Time : 30 minutes

Ambient Pressure : (1000 ± 50) hPa Relative Humidity

; (50 ± 20) %

Sampling

: As received

#### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

## Calibration specification

To perform the calibration of linearity and frequency response by multi-function sound calibrator.

## Calibration result

The results are detailed on the subsequent pages.

#### Remarks

- The calibration results apply to the particular unit-under-test only.

- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

Tommy TAM (Technician)

Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



## **Monthly EM&A Report**

Page	I-10
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, Veristrong Industrial Centre 34-36 Au Pui Wan Street, Fo Tan, Hong Kong



## Calibration Certificate

Certificate No. : CSA32590

Page : 2 of 3

### Calibration Result:

Reference Sound Pressure Level : (Unit in: dB)

Ra	nge / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor
	0000	94.0		94.8	0.8	0.13	2.0	
A-Weighting	Range	30 to 130	104.0	1	104.8	0.8	0.13	2.0
2000 800	Mode	Fast	114.0		114.8	0,8	0.13	2.0
	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
A-Weighting	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.1	0.1	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0	1	94.0	0.0	0.13	2.0
	Range	30 to 130	104.0		104.0	0.0	0,13	2.0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	30 to 130	104.0	1 1	104.0	0.0	0.13	2.0
2	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0		94,0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
Z-Weighting	Self-cal	After	94.0		94,0	0.0	0.13	2.0
	Range	30 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0

## Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level
- Laboratory reference multi-function sound calibrator was used to adjust the "Self cal" reading of UUT.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	
Works at Po Toi O	

## Monthly EM&A Report

Page I-11 Ref# EMA2204/03/18 Rev. 01

Jul 23





Date

T: +852 2695 8318 F: +852 2695 3944 E: etl@ets-testconsuit.com W: www.ets-testconsuit.com



## Calibration Certificate

東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

Form QSAS/C/US Issue 1(2/7) [09/21]

Certificate No. : CSA32590
Page : 3 of 3

#### Calibration Result:

Acoustic Sensitivity and Frequency Response:

2 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
			31.5	54.8	54.7	0.1	-39.4 +/- 2.0
		l 1	63	67.8	67.9	0.1	-26.2 H- 1.5
		l 1	125	77.9	78.0	0.1	-18.1 +/- 1.5
			250	85.4	85.4	0.0	-8.6 +/- 1.4
			500	90.8	90.8	0.0	-3.2 +/- 1.4
30 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
0000000			2000	95.1	95.2	0.1	+1.2 +/- 1.6
		1 1	4000	94.9	94.9	0.0	+1.0 +/- 1,6
		1 1	8000	92.9	92.0	-0.9	-1.1 (+2.1; -3.1)
			12500	09.7	85.1	-4.6	-4.3 (+3.0 ; -6.0)
			10000	87.5	79.8	-7.7	-6.6 (+3.5 ; -17.0)

3 Frequency Response C-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
			31,5	91.0	90.9	-0.1	-3.0 +/- 2.0
		1 1	63	93.2	93.2	0.0	-0.8 +/- 1.5
			125	93.8	93.9	0.1	-0.2 +/- 1.5
	Fast		260	94.0	94.0	0.0	0.0 +/- 1.4
			500	94.0	94.0	0.0	0.0 +/- 1.4
30 to 130		94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	93.7	93.8	0.1	-0.2 +/- 1.6
			4000	93.1	93.1	0.0	-0.8 +/- 1.6
			8000	91.0	90.1	-0.9	-3.0 (+2.1; -3.1)
		1	12500	87.8	83.2	-4.6	-6.2 (+3.0 ; -6.0)
			16000	85.6	77.9	-7.7	-8.5 (+3.5; -17.0)

4 Frequency Response Z-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Devlation	IEC 61672-1:2002 class Specification		
			31.5	94.0	94.0	0.0	0.0 +/- 2.0		
		I 1	63	94.0	94.0	0.0	0,0 +/- 1,5		
			125	94.0	94.0	0.0	0.0 +/- 1.5		
	Fast				250	94.0	94.0	0.0	0.0 +/- 1,4
			500	94.0	94.0	0.0	0.0 +/- 1.4		
30 to 130		94	1000 (Ref.)	94.0	94.0	0.0	0+/-1.1		
		1	2000	94,0	94.0	0.0	0,0 +/- 1.6		
- 1			4000	94.0	93.9	0.0	0.0 +/- 1.6		
		1	8000	94.0	93.0	-1.0	0.0 (+2.1; -3.1)		
		1	12500	94.0	89.7	-4.3	0.0 (+3.0; -6.0)		
		h	16000	94.0	87.6	-6.4	0.0 (+3.5; -17.0)		

Expended uncertainty of measurement

	Range (Hz)	(dB)	Range (Hz)	(dB)
-	31,5	0.15	2000	0.13
	63	0.15	4000	0.13
	125	0.15	8000	0.14
94 dB	250	0.14	12500	0.14
	500	0,12	16000	0.14
	1000	0.13	1	

- Manufacturer specification: IEC 61672 class 1
- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.
- UUT reading are mean of three measurements.
   Deviation = UUT Reading Reference Level

\*\*\*End of certificate\*\*\*



## Monthly EM&A Report

Page	I-12
Ref#	EMA2204/03/18
Rev.	01

Date Jul 23



## 東業德勤測試顧問有限公司 **ETS-TESTCONSULT LTD.**

8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Tan, Hong Kong



Form Q/AS/C/01 Issue 1(1/7) [09/21]

#### Calibration Certificate

Certificate No.

: CSA30088

Page

: 1 of

3

#### Information Provided by Customer

Customer Address

; ETS - Testconsult Limited

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong

## Information of Unit-under-test (UUT)

	Sound Level Meter	Microphone	Pre-amplifier
Manufacturer	RION	RION	RION
Туре	NL-31	UC-53A	NH-21
Equipment I.D. no.	ET/EN/003/12		
Serial No.	00773032	01291	25043
Adaptors used			
Resolution	0.1 dB	*	-

#### Laboratory Information

Lab. Ref. No. Date of Calibration : Q/CAL/23/0178/I : 11-Jan-2023

Procedure

; CQS/001/A

Date of Issue : 12-Jan-2023 Date of Receipt Calibration Location

; 9-Jan-2023 : Calibration Laboratory

### Calibration Condition

Ambient Temperature : (20 ± 3) °C Stabilizing Time : 30 minutes

Relative Humidity Sampling

: (50 ± 20) % : As received

; (1000 ± 50) hPa Ambient Pressure

#### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Signal generator, ET/2503/01

#### Calibration specification

To perform the calibration of linearity and frequency response by multi-function sound calibrator.

#### Calibration result

- The results are detailed on the subsequent pages.

The calibration results apply to the particular unit-under-test only.

 The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

Tommy TAM &. Tony MA (Technician)

Approved By:

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards.

This report shall not be reproduced unless with prior written approval from this laboratory.



## **Monthly EM&A Report**

Page	I-13
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

8/F Block B, eristrong Industrial Centre, 34-38 Au Pui Wan Street, Fo Tan, Hong Kong

T: +652 2695 8318 F: +852 2695 3944 E: eti@ets-testconsult.com W: www.els-testconsult.com



## Calibration Certificate

Certificate No. : CSA30088

Page: 2 of 3

### Calibration Result:

1 Reference Sound Pressure Level : (Unit in: dB)

Range / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor	
	Self-cal	Before	94.0		93.2	-0.8	0.13	2.0
	Range	40 to 130	104.0	1	103.2	-0.8	0.13	2.0
	Mode	Fast	114.0		113.2	-0.8	0.13	2.0
A-Weighting	Self-cal	Before	94.0		93.1	-0.9	0.13	2.0
	Range	40 to 130	104.0	1	103.1	-0.9	0.13	2.0
	Mode	Slow	114.0		113.2	-0.8	0.13	2.0
	Self-cal	After	94.0	1	94.0	0.0	0.13	2.0
	Range	40 to 130	104.0		104.0	0.0	0.13	2.0
	Mode	Fast	114.0		114.0	0.0	0.13	2.0
A-Weighting	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0
	Self-cal	After	94.0		94.0	0.0	0.13	- 2.0
	Range	40 to 130	104.0	1	104.0	0.0	0.13	2.0
0.141-1-1-1	Mode	Fast	114.0		114.0	0.0	0.13	2.0
C-Weighting	Self-cal	After	94.0		94.0	0.0	0.13	2.0
	Range	40 to 130	104.0	1 1	104.0	0.0	0.13	2.0
	Mode	Slow	114.0		114.0	0.0	0.13	2.0

2 Measurement for other range on reference sound pressure level: (Unit in: dB)

Range / Mode		Reference Level	REF Frequency (kHz)	UUT Reading	Deviation	Expanded Uncertatiny	Coverage Factor	
A-Weighting Mode Range	Range	20 to 100	20 to 100 94.0	1	94.0	94.0 0.0	0.13	2.0
	Mode	Fast						
	Range	0	94.0	4	0.0			
	Mode	0	54,0		0.0			

#### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level
- Laboratory reference multi-function sound calibrator was used to adjust the "Self cal" reading of UUT,

\*\*



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	LF
Works at Po Toi O	F

#### Monthly EM&A Report

Page	I-14
Ref#	EMA2204/03/18
Rev.	01

Jul 23



# 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.

Date



#### **Calibration Certificate**

Certificate No.

CSA30088

Page : 3 of 3

#### Calibration Result:

Acoustic Sensitivity and Frequency Response;

3 Frequency Response A-Weighting (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class 1 Specification
_			31.5	54.6	54.7	0.1	-39.4 +/- 2.0
			63	67.8	68.0	0.2	-26.2 +/- 1.5
- 20			125	77.9	78.1	0.2	-16.1 +/- 1.5
- 3			250	85.4	85.6	0.2	-8.6 +/- 1.4
			500	90.8	90.9	0.1	-3.2 +/- 1.4
40 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
			2000	95.1	94.9	-0.2	+1.2 +/- 1.6
			4000	94.9	94.0	-0.9	+1.0 +/- 1.6
			8000	92.9	90.2	-2.7	-1.1 (+2.1 ; - 3.1)
			12500	89.7	85.3	-4.4	-4.3 (+3.0 ; -6.0)
			16000	87.5	79.4	-8.1	-6.6 (+3.5; -17.0)

#### 4 Frequency Response C-Weighting : (Unit in: dB)

Range	Mode	Applied Level	Frequency (Hz)	Reference Level	UUT Reading	Deviation	IEC 61672-1:2002 class : Specification
			31.5	91.0	91.0	0.0	-3.0 +/- 2.0
			63	93.2	93.3	0.1	-0.8 +/- 1.5
			125	93.8	94.0	0.2	-0.2 +/- 1.5
			250	94.0	94.2	0.2	0.0 +/- 1.4
				500	94.0	94.1	0.1
40 to 130	Fast	94	1000 (Ref.)	94.0	94.0	0.0	0 +/- 1.1
	000,000		2000	93.7	93.5	-0.2	-0.2 +/- 1.6
			4000	93.1	92.2	-0.9	-0.8 +/- 1.6
			8000	91.0	88.3	-2.7	-3.0 (+2.1 ; -3.1)
			12500	87.8	83.4	-4.4	-6.2 (+3.0 ; -6.0)
			16000	85.6	77.4	-8.2	-8.5 (+3.5; -17.0)

- Expended uncertainty of measurement:

	Range (Hz)	(dB)	Range (Hz)	(dB)
	31.5	0.15	2000	0.13
- 1	63	0.13	4000	0.13
	125	0.13	8000	0.14
94 dB	250	0.12	12500	0.14
1	500	0.12	16000	0.14
- 1	1000	0.13		

Remark:

- Manufacturer specification:
- IEC 61672 class 1
- Signal level at 1000 Hz is set as indication of reference sound pressure level.
- The uncertainty quoted is based on 95 % confidence level with coverage factor k=2.0.
- UUT reading are mean of three measurements.
- Deviation = UUT Reading Reference Level

\*\*\*End of certificate\*\*\*



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		I-15
		EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23



## 東業德勤測試顧問有限公司 ETS-TESTCONSULT LTD.



Form Q/AS/C/02 Issue 1(1/4) [02/22]

#### Calibration Certificate

: CSA33530 Certificate No.

Page

Information Provided by Customer

: ETS - Testconsult Limited Customer

: 8/F., Block B, Veristrong Industrial Centre, 34 - 36 Au Pui Wan Street, Fotan, Shatin, Hong Kong Address

Information of Unit-under-test (UUT)

: Sound Level Calibrator Description

Manufacturer Equipment I.D. : ET/EN/002/07 : 038641 : GA607 Serial No. Туре

Laboratory Information

: Q/CAL/23/4006/I : CQS/002/A Lab. Ref. No. ; 17-May-2023 Date of Calibration 19-May-2023 Date of Receipt : 19-May-2023 Calibration Location : Calibration Laboratory

Calibration Condition

Relative Humidity : (50±20) % Ambient Temperature : (20 ± 3) °C : As received Stabilizing Time : 30 minutes Sampling : (1000 ± 50) hPa Ambient Pressure

#### Reference equipment

- Multi-function sound calibrator, ET/2801/01
- Measuring Amplifier, ET/2702/01/01
- Signal generator, ET/2503/01
- Reference Oscilloscope, ET/2502/01

#### Calibration specification

To perform the calibration of sound level calibrator,

#### Calibration result

- The results are detailed on the subsequent pages.

#### Remarks

The calibration results apply to the particular unit-under-test only.

- The values given in this calibration certificate only to the values measureed at the time of test & any uncertainties quoted will not include allowance for the equipment long term drift, varifications with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement

Calibrated By:

Tony MA (Technician) Approved By: \_

CHAN Chi Wai

The results shown in this certificate are traceable to the International System of Units (SI) or recognised measurement standards. This report shall not be reproduced unless with prior written approval from this laboratory.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		I-16
		EMA2204/03/18
Monthly EM&A Report		01
		Jul 23



8/F Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fo Ten, Hong Kong

T: +852 2895 8318 F: +852 2895 3944 E: ell@els-festconsult.com W: www.ets-testconsult.com



#### Calibration Certificate

Certificate No. : CSA33530

Page: 2 of 2

#### Calibration Result:

#### 1. Measured Sound Pressure Level:

Nominal Frequency (Hz)	Nominal Output Sound Pressure (dB)	Measured Output (dB)	Expanded Uncertatiny (dB)	Coverage Factor
1000	94.0	94.1	0.13	2.0
1000	104.0	104.0	0.13	2.0

#### 2. Actual Output Frequency:

Nominal Frequency (Hz)	Nominal Output Sound Pressure (dB)	Measured Output (Hz)	Expanded Uncertatiny (Hz)	Coverage Factor
1000	94.0	1000.020	0.057	2.0
1000	104.0	1000.017	0.057	2.0

#### Remark:

- The uncertainty quoted is based on 95 % confidence level.
- Measured output are mean of three measurements.

\*\*\*End of certificate\*\*\*



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Page I-12 Works at Po Toi O Ref# EMA2204/03/18 Monthly EM&A Report Rev. 01 Date Jul 23



E13-TE3TCONSOCT ETD.							
	Calibration	on record of A	nemometer				
Equipment Ref. N	o. : <u>ET/EN/0</u>	01/05 Manu	facturer :	AZ Instrument			
Model No.	:AZ 89	908 Serial	No. :	1064869			
Date of Check	: <u>28-Oct-</u>	2022 Due D	Date :	27-Oct-2023			
Method							
2 A fan with vario 3 Adjust the spee 4 Use the referen 5 Record the indi 6 Apply the corre	us speed control had s id and direction of the f ice anemometer and th cated value of both and cted value in the refere	ngth about 1m was use set in on end of the pipe fan to achieve the targe ne unit under test to che emometer ence anemometer and d not over ±5% of the F	e t wind speeds eck the wind speed in calculate the corrected				
Reference Ane	mometer						
Equipment Ref. N	o. : <u>ET/121</u>	5/01 Calibr	ration Due Date :	15-Aug-2024			
Results	ature :23.0		ve Humidity :				
Applied Range		emometer (m/s)	Indicated Value	r Test (m/s) Corrected Value			
(m/s)	Indicated Value 0.00	Corrected Value 0.00	0.0	0.0			
		2.51	2.4	+0.1			
2 - 3	2.52 5.36	5.50	5.3	+0.2			
9 - 11	10.1	10.2	9.8	+0.4			
14 - 16	15.0	15.3	14.7	+0.6			
18 - 20	18.9	19.2	18.5	+0.7			
-	Acceptance Criteria  Correction value should < ±5% FS						
deemed accepta	The Anemometer complies * / does-not comply * with the specified requirements and is deemed acceptable * / unacceptable * for use. * Delete as appropriate						
Checked by	Checked by : Approved by :						



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		J-1
		EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23

## APPENDIX J - NOISE IMPACT MONITORING RESULT



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		J-2
		EMA2204/03/18
Monthly EM&A Report		01
monthly _me/t/topers	Date	Jul 23

# Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2023 June Noise Monitoring Data

**Monitoring Location: NMS1N** 

Date	Noise Monitoring (30min)		
Date	Leq dB(A)	L10 dB(A)	L90 dB(A)
6-Jun-23	57.6	59.3	55.1
12-Jun-23	54.1	57.3	43.3
21-Jun-23	60.4	62.5	51.2
27-Jun-23	71.1	72.6	68.3
Average	65.7		
Action Level:	When one valid documented complaint is received		
Limit Level:	75.0 dB(A)		



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-3
	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2023 June Noise Monitoring Data

**Monitoring Location: NMS2N1** 

Date	Noise Monitoring (30min)		
Date	Leq dB(A)	L10 dB(A)	L90 dB(A)
6-Jun-23	59.7	62.2	55.1
12-Jun-23	56.7	59.0	50.3
21-Jun-23	56.6	58.4	50.8
27-Jun-23	64.8	66.8	63.0
Average	60.9		
Action Level:	When one valid documented complaint is received		
Limit Level:	75.0 dB(A)		



ED 540/0040 Part Ohallan Causanana Otanao Causanana Warka at Da Tai O		J-4
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly _me/t/tope.t	Date	Jul 23

## Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant

2023 June Noise Monitoring Data

**Monitoring Location: NMS3N** 

Date	Noise Monitoring (30min)		
Date	Leq dB(A)	L10 dB(A)	L90 dB(A)
6-Jun-23	56.1	58.0	52.3
12-Jun-23	56.6	59.1	50.5
21-Jun-23	58.9	61.0	51.4
27-Jun-23	53.3	54.8	52.6
Average	56.7		
Action Level:	When one valid documented complaint is received		
Limit Level:	75.0 dB(A)		



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-5
	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
mentally _max.respon	Date	Jul 23


## Monthly Environmental Monitoring & Audit Report for Port Shelter Phase 3, Po Toi O Sewerage Treatment Plant 2023 June Noise Monitoring Data

**Monitoring Location: NMS4N** 

Date	Noise Monitoring (30min)		
Date	Leq dB(A)	L10 dB(A)	L90 dB(A)
6-Jun-23	57.5	56.3	50.4
12-Jun-23	52.3	54.6	48.7
21-Jun-23	56.6	58.1	51.6
27-Jun-23	49.3	51.7	46.1
Average	55.0  When one valid documented complaint is received 75.0 dB(A)		
Action Level:			
Limit Level:			




Page	J-6			
Ref#	EMA2204/03/18			
Rev.	01			
Date	Jul 23			

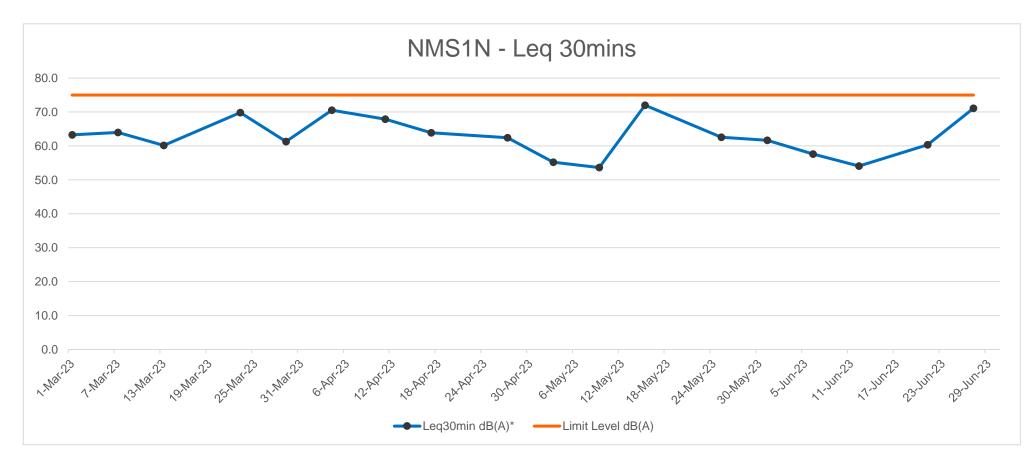



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	J-7
	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

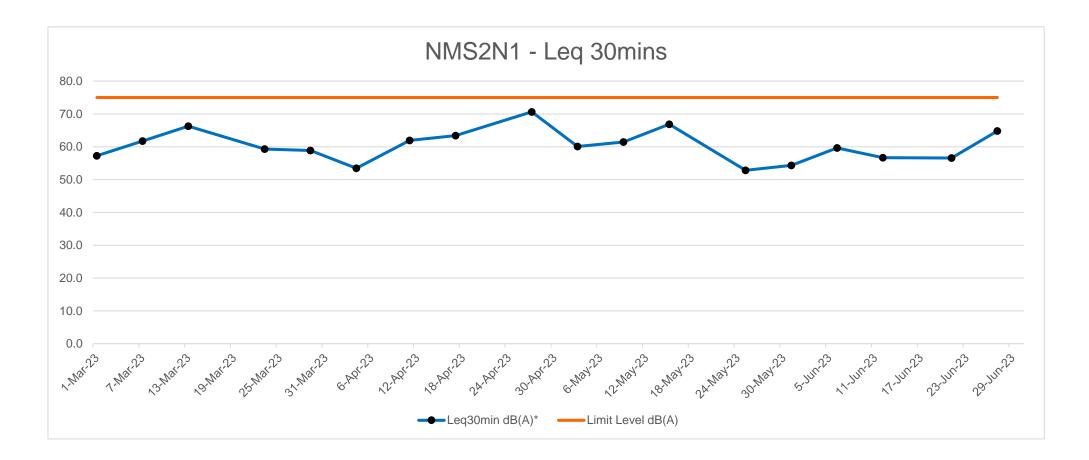




ED E40/2040 Port Chalter Coverage Starra Coverage Works at Da Tai O	raye
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#

Monthly EM&A Report


Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

J-8

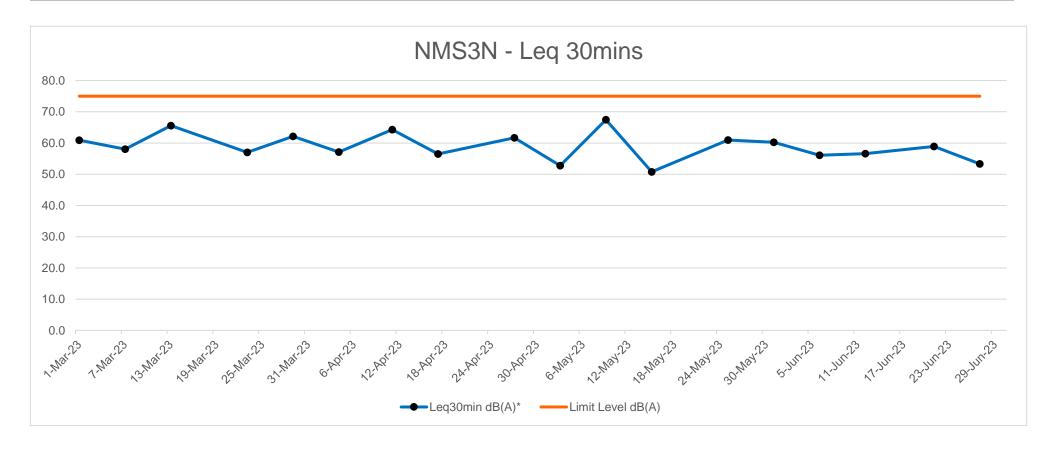



ED 540/0040 Down Challes Courses Champa Courses Works at Do Toi O	Page	J-9
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O		EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emarcroport	Date	Jul 23

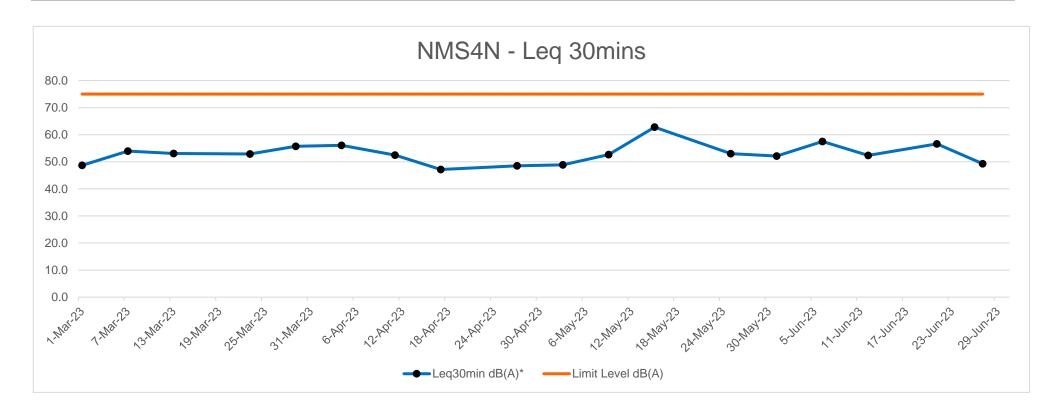



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	K-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## APPENDIX K - MONTHLY SUMMARY OF WASTE FLOW



ED 540/0040 Port Chalter Courses Stored Courses Warks at Do Toi O	Page	K-2
EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
monthly Emax Report		Jul 23

## **Monthly Summary Waste Flow Table for 2023 Year**

		Actual Quant	tities of Inert	C&D Materi	als Generate	d Monthly	Actual	Quantities of 0	C&D Waste	s Generated	Monthly
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposal as Public Fill	Imported Fill	Metals	Paper / Cardboard Packaging	Plastics (see note 3)	Chemical Waste	Other, e.g. general refuse
	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	(in '000m³)	[in '000kg]	[in '000kg]	[in '000kg]	[in '000kg]	[in Tonne]
Jan	0.003	0.000	0.000	0.000	0.003	0.000	0.000	0.000	0.000	0.000	0.000
Feb	0.007	0.000	0.000	0.000	0.007	0.000	0.000	0.000	0.000	0.000	0.000
Mar	0.676	0.000	0.000	0.000	0.676	0.000	0.000	0.000	0.000	0.000	0.000
Apr	0.336	0.000	0.000	0.000	0.336	0.000	0.000	0.000	0.000	0.000	0.000
May	0.091	0.000	0.000	0.000	0.091	0.000	0.000	0.000	0.000	0.000	0.000
June	0.004	0.000	0.000	0.000	0.004	0.000	0.000	0.000	0.000	0.000	0.000
Sub- Total	1.117	0.000	0.000	0.000	1.117	0.000	0.000	0.000	0.000	0.000	0.000
July											
Aug											
Sep											
Oct											
Nov											
Dec											
Total	1.117	0.000	0.000	0.000	1.117	0.000	0.000	0.000	0.000	0.000	0.000

Note:

- 1) The performance targets are given in the Environmental Management Plan.
- (2) The waste flow table shall also include C&D materials to be imported for use at the Site.
- (3) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	L-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## APPENDIX L - IMPLEMENTATION SCHEDULE OF RECOMMENDED MITIGATION MEASURES



## EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

Page	L-2
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

EIA	EM	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	& A		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
	Ref.		Main Concerns to address					Guidelines
Air Qua	ality imp	act			I.	l	l	
Project	t Specifi	c Measures						
3.8	A1	Deodourizer should have at least 99.5% hydrogen sulfide removal	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		efficiency.	sensitive receivers		Treatment Plant	operational phase		
3.8	A2	Odourous materials (sludge, screenings and grits, worn filter)	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		should be stored and removed in sealed tankers and containers.	sensitive receivers		Treatment Plant	operational phase		
3.8	А3	Sludge should be transferred to sludge tanker by coupling	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		method.	sensitive receivers		Treatment Plant	operational phase		
3.8	A4	During release of pressure from the tanker, the odourous gas	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		should be discharged into the sludge storage room for extraction	sensitive receivers		Treatment Plant	operational phase		
		to deodourization unit.						
3.8	A5	Regular inspection should be conducted to check for leakage of	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		odourous gas.	sensitive receivers		Treatment Plant	operational phase		
3.8	A6	Maintain the removal efficiency of screenings and grits by	To maintain the removal	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		flushing the screens and grit sump regularly to prevent buildup of	efficiency of screenings and		Treatment Plant	operational phase		
		solids	grits					
3.8	A7	Maintain the efficiency of MBR membrane by removing	To maintain the efficiency of	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		organic and inorganic debris regularly	MBR membrane		Treatment Plant	operational phase		
3.8	A8	Replace worn filter to maintain the odour removal efficiency at	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
		99.5%	sensitive receivers		Treatment Plant	operational phase		
3.8	A9	Clean all the tanks with water regularly	To minimize odour nuisance to	DSD	Sewage	Throughout	Operational phase	EIAO-TM
			sensitive receivers		Treatment Plant	operational phase		
Genera	al/Stand	ard Measures		•	1	•		•
3.8	A10	Good housekeeping to minimize dust generation, e.g. by	To minimize dust generation	DSD's Contractor	Whole	Throughout	Construction	EIAO-TM,
		properly handling and storing dusty materials			construction	construction phase	Phase	APCO
					site	F		
3.8	A11	Adopt dust control measures, such as dust suppression using	To minimize dust generation	DSD's Contractor	Whole	Throughout	Construction	EIAO-TM,
		water spray on exposed soil (at least 4 times per day), in areas	due to erosion		construction	construction phase	phase	APCO
		with dusty construction activities and during material handling			site	,		



## EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-3 Ref# EMA2204/03/18

Rev.	01
Date	Jul 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
3.8	A12	Store cement bags in shelter with 3 sides and the	To prevent leakage of cement	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		top covered by impervious materials if the stack		Contractor	construction	construction	phase	
		exceeds 20 bags			site	phase		
3.8	A13	Maintain a reasonable height when dropping	To minimize dust generation during movement of excavated	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		excavated materials to limit dust generation	materials	Contractor	construction	construction	phase	
					site	phase		
3.8	A14	Limit vehicle speed within construction site and in	To minimize dust generation due to traffic movement	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		Po Toi O to 10km/hr and confine vehicle		Contractor	construction	construction	phase	
		movement in haul road			site	phase		
3.8	A15	Minimize exposed earth after completion of work in	To minimize dust generation due to erosion	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		a certain area by hydroseeding, vegetating, soil		Contractor	construction	construction	phase	
		compacting or covering with bitumen			site	phase		
3.8	A16	Provide wheel washing at construction site exit to	To prevent dust from being brought offsite	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		clean the vehicle body and wheel		Contractor	construction	construction	phase	
					site	phase		
3.8	A17	Cover materials on trucks before leaving the	To prevent falling of debris during traffic movement and by wind	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		construction site to prevent debris from dropping		Contractor	construction	construction	phase	
		during traffic movement or being blown away by			site	phase		
		wind						
3.8	A18	Regular maintenance of plant equipment to	To minimize black smoke emission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		prevent black smoke emission		Contractor	construction	construction	phase	
					site	phase		
3.8	A19	Throttle down or switch off unused machines or	To minimize unnecessary emission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		machine in intermittent use		Contractor	construction	construction	phase	
					site	phase		
3.8	A20	Minimize excavation area as far as possible	To minimize dust emission and potential release of odour from	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
			exposed ground	Contractor	construction	construction	phase	
					site	phase		



#### L-4 Page EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O EMA2204/03/18 Ref# 01 Rev.

Jul 23

Date

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
3.8	A21	Store odourous excavated materials in covered	To minimize odour nuisance to sensitive receivers	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		containers and remove off-site as soon as possible		Contractor	construction	construction	phase	
		within 24 hours			site	phase		
3.8	A22	Cover open stockpiles of construction materials	To prevent soil erosion under rainstorm	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		(e.g. aggregates, sand and fill materials) with		Contractor	construction	construction	phase	
		impermeable materials such as tarpaulin during			site	phase		
		rainstorms						
3.8	A23	Hoarding of not less than 2.4 m high shall be	To minimize dust emission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		erected from ground level to surround the		Contractor	construction	construction	phase	
		construction site for sewage treatment plant along			site	phase		
		Po Toi O Chuen Road except for a construction						
		site entrance or exit						
3.8	A24	Carry out air quality monitoring throughout the	To monitor construction dust level	DSD's	At	Prior to and	Construction	EIAO-TM
		construction period		Contractor	representative	throughout	phase	
					ASRs	construction		
						phase		
3.8	A25	Carry out regular site inspection to audit the	To check the implementation status and effectiveness of	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		implementation of mitigation measures	mitigation measures	Contractor	construction	construction	phase	
					site	phase		



### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

#### 

Page

L-5

EIA	EM	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	& A		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
	Ref.		Main Concerns to address					Guidelines
Noise	Impact							
Projec	t Specif	fic Measures						
4.7	N1	Use hand-held plant equipment or manual equipment within village area	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
4.7	N2	For HDD, enclose the stationary plant equipment on three sides with cover. Only the side facing the sea shall be opened for heat exhaustion.	To lower noise transmission	DSD's Contractor	HDD work site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N3	Generator should be placed at a fixed location at least 5-6m away from the NSRs and screened by noise barrier whenever excavation work has to be carried out at their front doors	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N4	Avoid carrying out noisy activities at the same time. The work front of village sewer installation near NSRs PTO_N1 and PTO_N3 shall not be conducted concurrently with installation of Po Toi O Chuen Road sewer and horizontal directional drilling respectively.	To minimize noise production	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N5	Vibratory poker shall only be operated 4m away from NSR and with noise barrier properly erected. Surfacing work within 4m from NSR shall be carried out by manual method	To minimize noise production	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM
Gener	ric/Stand	dard Measures		•		•		
4.7	N6	Schedule noisy activities to minimise exposure of nearby NSRs to high levels of construction noise	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N7	Use Quality Powered Mechanical Equipment (QPME) which produces lower noise level	To minimize construction noise level	DSD's Contractor	Whole construction site	Throughout construction phase	Construction Phase	NCO, EIAO-TM
4.7	N8	Erect 3m high mobile barriers with skid footing and a small cantilevered upper portion within a few metres of stationary plants and within about 5m of more mobile plant.	To lower noise transmission	DSD's Contractor	Whole construction site	Throughout construction phase	Construction phase	NCO, EIAO-TM



## EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-6 Ref# EMA2204/03/18

Rev.	01
Date	Jul 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
4.7	N9	Hand-held breaker shall be fitted with mufflers. A movable enclosure made	To lower noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		up of plywood is proposed to surround both worker and breaker during		Contractor	construction	construction	phase	
		breaking process. The internal wall of the enclosure should be laid with			site	phase		
		sound absorbent such as mineral wool.						
4.7	N10	Regular maintenance of plant equipment to prevent noise emission due to	To prevent noise emission due	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		impair	to impair	Contractor	construction	construction	phase	
					site	phase		
4.7	N11	Position mobile noisy equipment in location and direction away from NSR	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
			to NSR	Contractor	construction	construction	phase	
					site	phase		
4.7	N12	Use silencer or muffler on plant equipment and should be properly	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		maintained		Contractor	construction	construction	phase	
					site	phase		
4.7	N13	Throttle down or switch off unused machines or machine in Intermittent	To minimize noise production	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
		use between work		Contractor	construction	construction	phase	
					site	phase		
4.7	N14	Make good use of stockpiles or other structures for noise screening	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
4.7	N15	Mobile plant should be sited as far away from NSRs as possible	To minimize noise transmission	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
4.7	N16	Reduce the percentage on-time for some noisy PMEs	To mimize noise production	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
4.7	N17	Carry out noise monitoring	To monitor construction noise	DSD's	At	Prior to and	Construction	EIAO-TM, APCO
			level	Contractor	representative	throughout	phase	
					NSRs	construction		
						phase		



## EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-7 Ref# EMA2204/03/18

IVEI#	LIVI/ (220-7/00/ 1
Rev.	01
Date	Jul 23

EIA	EM	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant
Ref.	& A		Recommended Measure &	Agent	the measure	the	stages	Legislation &
	Ref.		Main Concerns to address			measure		Guidelines
Water	Quality	Impact		l	1	.1	•	
Projec	t Specif	ic Measures						
5.8	W1	Divert the water from outfall of W3 (stream near Fairway Vista) during open cut	To prevent the excavated	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		excavation for laying of gravity sewer nearby	materials from falling into the	Contractor	construction site	construction	phase	EIAOTM
			water and being carried into the		one o	phase		
			sea					
5.8	W2	Place sandbag along the upstream section of the stream near Fairway Vista and	To prevent the excavated	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		along rocky shore during open cut excavation for laying of gravity sewers/rising	materials from falling into the	Contractor	construction	construction	Phase	EIAOTM
		mains nearby.	water and being carried into the		site	phase		
			sea					
5.8	W3	Intercept the water from u-channel at the foot of the slope where the STP will be	To prevent water from entering	DSD's	Whole	Throughout	Construction	EIAO-TM
		built	the construction site	Contractor	construction site	construction	Phase	
					Sito	phase		
5.8	W4	Install cofferdam around the proposed excavation area for entry pit of HDD work	To prevent debris from entering	DSD's	HDD work site	Throughout	Construction	EIAO-TM
		to prevent falling of debris into the sea	the waterbodies	Contractor		construction	Phase	
						phase		
5.8	W5	Install sheet piles in marine waters by vibratory action.	To minimize dispersion of	DSD's	Whole	Throughout	Construction	EIAO-TM
			marine sediment	Contractor	construction site	construction	phase	
					one o	phase		
5.8	W6	Marine works (dredging, construction and installation works at diffuser location,	To minimize dispersion of	DSD's	Whole	Throughout	Construction	EIAO-TM
		backfilling) shall be carried out inside the watertight cofferdam. The cofferdam	marine sediment	Contractor	construction site	construction	Phase	
		can only be removed after completion of work				phase		
5.8	W7	Dredging should be carried out by grab dredgers anchored outside the cofferdam.	To minimize dispersion of	DSD's	Whole	Throughout	Construction	EIAO-TM
		The marine sediment should be placed in sealed compartment of the marine	marine sediment	Contractor	construction site	construction	Phase	
		barge.				phase		
5.8	W8	Water removed from the cofferdam should be desilted before discharge back into		DSD's	Whole	Throughout	Construction	EIAO-TM
		the sea.	To prevent discharge of silty	Contractor	construction site	construction	phase	
			water into the sea		O.LO	phase		



#### Page L-8 EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O EMA2204/03/18 Ref# 01 Rev.

INGV.	UI
Date	Jul 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
5.8	W9	Carry out water quality monitoring at water sensitive receivers before and during	To identify any water quality	DSD's	Water	Before and	Construction	EIAO-TM
		cofferdam installation works, throughout dredging works, and during cofferdam	impact due to construction	Contractor	Monitoirng	throughout	phase	
		extraction works	works		Stations	installation and		
						extraction works		
						of cofferdam		
5.8	W10	The following summarizes the precautionary measures for	To prevent emergency	DSD	Sewage	Operational phase	Operational	EIAO-TM
		minimizing chance of emergency discharge:	discharge		Treatment Plant		phase	
		Provision of dual power by CLP;						
		Equipped with Supervisory control and data acquisition system (SCADA), which						
		signals to the operation and maintenance personnel for emergency attendance in						
		case of plant failure;						
		Provision of standby pump and screen at the PTOSTW.						
		Provision of emergency generator within 4 hours by DSD's future term contractor.						
		Provision of emergency storage with capacity of 4-hr sewage retention time.						
		Arrangement of tankers for removing incoming sewage to other sewage treatment						
		plants for treatment.						
5.8	W11	Carry out water quality monitoring at water sensitive receivers during normal	To identify any water quality	DSD	At	6 months before	Operational	WPCO, EIAO-TM
		operation	impact due to the normal		representative	and in 1st year of	phase	
			operation of the Sewage		WSRs	operation		
			Treatment Plant (STP)					
Generi	c/Standard M	easures		•			•	
5.8	W12	Set up sedimentation tank for settling suspended solids in wastewater before	To reduce the amount of	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		discharge into storm drains. Sand/silt removal facilities such as sand traps, silt traps	suspended solid in wastewater	Contractor	construction	construction	phase	EIAO-TM
		and sedimentation basin should be provided with adequate capacity.			site	phase		
5.8	W13	Follow ProPECC PN 1/94 "Construction Site Drainage" as far as practicable	To minimize surface runoff and	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
			chance of erosion	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W14	Construct catchpits and perimeter channels prior to commencement of site formation	To stop runoff from flowing	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		works and earthworks.	across the construction site	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W15	Maintain silt removal facilities, channels, manholes before and after rainstorm.	To prevent failure that may lead	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
			to flooding	Contractor	construction	construction	phase	EIAO-TM
					site	phase		



### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

Page	L-9
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
5.8	W16	Remove silt and grit from silt trap at regular interval.	To prevent blockage the may	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
			lead to flooding	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W17	Well design works program to minimize the work areas to minimize the soil exposure	To minimize surface runoff and	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		and site runoff.	chance of erosion	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W18	Arrange soil excavation works outside rainy seasons (April to September) as far as	To minimize surface runoff and	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		possible. If this cannot be achieved, the following measures should be implemented:	chance of erosion	Contractor	construction	construction	phase	EIAO-TM
		- Cover temporary exposed slope surfaces with impermeable materials, e.g. tarpaulin			site	phase		
		- Protect temporary access roads by crushed stone or gravel						
		- Provide intercepting channels along crest/edge of excavation						
		- Carry out adequate surface protection measures well before the arrival of a rainstorm						
5.8	W19	Minimize exposed earth after completion of work in a certain area by hydroseeding,	To prevent soil erosion under	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		vegetating, soil compacting or covering with bitumen	Rainstorm	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W20	Prevent rainwater from entering trenches. Excavation of trenches should be dug and	To prevent soil erosion under	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		backfilled in short sections during rainy seasons. Remove silt in rainwater collected	Rainstorm	Contractor	construction	construction	phase	EIAO-TM
		from the trenches or foundation excavations prior to discharge to storm drains.			site	phase		
5.8	W21	Cover open stockpiles of construction materials (e.g. aggregates, sand and fill	To prevent soil erosion under	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		materials) with impermeable materials such as tarpaulin during rainstorms.	rainstorm	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W22	Cover and temporary seal manholes to prevent silt, construction materials or debris	To prevent overloading of foul	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94,
		and surface runoff from entering foul sewers.	sewers	Contractor	construction	construction	phase	EIAO-TM
					site	phase		
5.8	W23	Remove waste from the construction site regularly.	To prevent waste accumulation	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
				Contractor	construction	construction	phase	
					site	phase		
5.8	W24	Apply discharge license for effluent discharge. Treat the discharge to comply with the	To ensure compliance with	DSD's	Whole	Throughout	Construction	WPCO, TM-DSS,
		requirement in TM-DSS.	effluent discharge requirement	Contractor	construction	construction	phase	EIAOTM
					site	phase	,	



#### Page L-10 EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O EMA2204/03/18 Ref# 01 Rev.

Jul 23

Date

EIA Ref.	EM & A Ref.	Recommended Mitigation Measures *	Objectives of the Recommended Measure & Main Concerns to address	Implementation Agent	Location of the measure	Duration of the measure	Implementation stages	Relevant Legislation & Guidelines
5.8	W25	Reuse treated effluent onsite, e.g. dust suppression, wheel washing and general cleaning.	To minimize wastewater	DSD's	Whole	Throughout	Construction	Waste Disposal
			generation	Contractor	construction	construction	phase	Ordinance, EIAO-
					site	phase		TM
5.8	W26	Monitor effluent water quality	To ensure compliance with	DSD's	Whole	Throughout	Construction	WPCO, EIAO-TM
			effluent discharge requirement	Contractor	construction	construction	phase	
					site	phase		
5.8	W27	Register as chemical waste producer if chemical waste will be generated.	To control chemical waste	DSD's	Whole	Throughout	Construction	Waste Disposal
				Contractor	construction	construction	phase	(Chemical
					site	phase		Waste) (General)
								Regulation, EIAO-
								TM
5.8	W28	Perform maintenance of vehicles and equipment that have oil leakage and spillage potential on	To prevent oil leakage or	DSD's	Whole	Throughout	Construction	Waste Disposal
		hard standings within a bunded area with sumps and oil interceptors.	spillage	Contractor	construction	construction	phase	(Chemical
					site	phase		Waste) (General)
								Regulation, EIAO-
								TM
5.8	W29	Dispose chemical waste in accordance to Waste Disposal Ordinance. Follow the Code of Practice	To avoid accident in waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		on the Packaging, Labelling and Storage of Chemical Wastes, examples as follows:	storage and handling	Contractor	construction	construction	phase	Ordinance, EIAO-
		- Store chemical wastes with suitable containers to avoid leakage or spillage during storage,			site	phase		TM
		handling and transport						
		- Label chemical waste containers according to the CoP to notify and warn the waste handlers						
		- Store chemical wastes at designated safe location with adequate space						
5.8	W30	Provide sufficient chemical toilets with regular maintenance by registered waste collector where	To proper collection of tasks	DSD's	Whole	Throughout	Construction	Waste Disposal
		necessary	force waste	Contractor	construction	construction	phase	Ordinance, EIAO-
					site	phase		TM
5.8	W31	Provide a drip tray/container underneath the bentonite recycling system	To prevent any leaked bentonite	DSD's	Whole	Throughout	Construction	EIAO-TM
			from entering the watercourse	Contractor	construction	construction	phase	
			or sea		site	phase		
5.8	W32	Carry out regular site inspection to audit the implementation of mitigation measures	To check the implementation	DSD's	Whole	Throughout	Construction	EIAO-TM, APCO
			status and effectiveness of	Contractor	construction	construction	phase	
			mitigation measures		site	phase		
5.8	W33	Carry out effluent quality monitoring at location specified in the discharge licence	To ensure compliance with effluent discharge requirement	DSD	Effluent outlet	Operational phase	Operational phase	WPCO, EIAO-TM



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page Ref# L-11 Monthly EM&A Report Rev. 01 Date Jul 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Α		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
	Ref.		Main Concerns to address					Guidelines
Terrestri	al Ecology	y		l			1	
Project S	Specific M	easures						
6.12	E1	Erect bright color fencing along the boundary of the undisturbed region of the shrubland and	To protect the shrub from being	DSD's	Whole	Throughout	Construction	EIAO-TM
		woodland, and around Diospyros vaccinioides, a plant species of conservation importance,	Damaged	Contractor	construction site	construction	phase	
		near the work boundary to remind workers not to trespass or occupy the area, and to be				phase	'	
		careful during operation of equipment.						
6.12	E2	Reinstate the disturbed rocky shore with the rocks temporarily removed	To restore the rocky shore	DSD's	HDD work site	After completion	Construction	EIAO-TM
			habitat	Contractor		of works near the	Phase	
						rocky shore		
6.12	E3	Place sandbag around the section of W3 next to Fairway Vista and along the shore during	To prevent the excavated	DSD's	Whole	When	Construction	EIAO-TM
		open cut excavation for laying of gravity sewer nearby.	materials from falling into the	Contractor	Contractor construction site	construction work	Phase	
			water and being carried into the			is carried out in		
			sea			the vicinity of W3		
6.12	E4	Temporarily divert the water from outfall of W3 away from excavation area.	To prevent the excavated materials from	DSD's	Whole	When	Construction	EIAO-TM
			falling into the water and being carried into	Contractor	construction site	construction work	Phase	
			the sea			is carried out in		
						the vicinity of W3		
6.12	E5	Inspect the condition of the Diospyros vaccinioides near the work boundary as part of weekly	To inspect the condition of the Diospyros	DSD's	Whole	Throughout	Construction	EIAO-TM
		site audit	vaccinioides	Contractor	construction site	construction	phase	
						phase	· ·	
Generic	Standard	Measures					•	
6.12	E6	Erection of hoarding, fencing or provision of clear demarcation of work zones	To remind workers not to	DSD's	Whole	Throughout	Construction	EIAO-TM
			damage area outside the work boundary	Contractor	construction site	construction	Phase	
						phase		
6.12	E7	Designate areas for placement of equipment, building materials and wastes away from the	To prevent damage on the	DSD's	Whole	Throughout	Construction	EIAO-TM
		natural environment	natural environment	Contractor	construction site	construction	Phase	
						phase		
6.12	E8	Carry out tree preservation and compensatory tree planting will be carried out in accordance		DSD's	Whole	After completion	Construction	EIAO-TM
		with DEVB TCW No. 7/2015.	To reinstated woodland habitat	Contractor	construction site	of works near	phase	
					5.10	woodland	,	



### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

#### 

Page

L-12

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
Terres	trial Ecology	,		1		•	•	
Project	Specific Me	asures						
9.8	WM1	Sludge will be delivered by sealed sludge tanker for treatment at Sludge	To prevent odour nuisance	DSD	STP	Throughout	Operational	Waste Disposal
		Treatment Facilities				construction	phase	(Chemical
						phase		Waste)
								(General)
								Regulation,
								EIAO-TM
9.8	WM2	Debris from screening process and general refuse should be stored within	To prevent odour nuisance	DSD	STP	Throughout	Operational	Waste Disposal
		the STP in sealed container and be disposed of at landfill regularly.				construction	phase	(Chemical
						phase		Waste)
								(General)
								Regulation,
								EIAO-TM
9.8	WM3	Worn filters and MBR membrane shall be stored and labelled as in	To prevent odour nuisance	DSD	STP	Throughout	Operational	Waste Disposal
		construction phase. Chemical wastes shall be treated at chemical				construction	phase	Ordinance,
		treatment facility by licensed contractor				phase		EIAO-TM
Generi	c/Standard N	Measures						
9.8	WM4	Allocate an area for waste sorting and storage of C&D materials	To minimize waste generation	DSD's	Whole	Throughout	Construction	Waste Disposal
		into the following categories for reuse, recycle or disposal if		Contractor	construction site	construction	Phase	Ordinance,
		possible. Remove waste from the construction site for sorting				phase		EIAO-TM
		once generated if no suitable space can be identified.						
		- excavated materials suitable for reuse						
		- inert C&D materials (or public fill) for disposal offsite						
		- non-inert C&D materials (or C&D waste) for disposal at						
		landfills						
		- chemical waste						
		- bentonite slurry for reconditioning and reuse						
		- general refuse						



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-13 Ref# EMA2204/03/18 Rev. 01

Jul 23

Date

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
9.8	WM5	Adopt good site practice as follows:	To proper handling of waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		- Provide training to workers on site cleanliness, waste		Contractor	construction	construction	phase	Ordinance,
		management (waste reduction, reuse and recycle) and chemical			site	phase		EIAO-TM
		handling procedures						
		- Provide sufficient waste collection points and regular removal						
		- Cover waste materials with tarpaulin or in enclosure during						
		transportation						
		- Maintain drainage systems, sumps and oil interceptors						
		- Sort out chemical waste for proper handling and treatment						
		onsite or offsite						
9.8	WM6	Adopt waste reduction measures as follows:	To minimize waste generation	DSD's	Whole	Throughout	Construction	Waste Disposal
		- Allocate area/containers for sorting, recovering and storing		Contractor	construction	construction	phase	Ordinance,
		waste for reuse, recycle or disposal (e.g. demolition debris and			site	phase		EIAO-TM
		excavated materials, general refuse like aluminium cans.)						
		Remove waste from the construction site for sorting once						
		generated if no suitable space can be identified.						
		- Allocate area for proper storage of construction materials to						
		prevent contamination						
		- Minimize wastage through careful planning and avoiding overpurchase						
		of construction materials						
9.8	WM7	Prepare and implement a site-specific Waste Management Plan (WMP) as	To provide guidance to waste	DSD's	Whole	Throughout	Construction	ETWB TCW
		part of Environmental Management Plan (EMP) in accordance with ETWB	management	Contractor	construction	construction	phase	No.
		TCW No. 19/2005. Detail waste management method in the form of			site	phase		19/2005, EIAO-
		avoidance, reuse, recovery, recycling, storage, collection, treatment and						TM
		disposal according to the recommendations on the EIA and EM&A Manual.						
		It should be approved by the ER and regularly reviewed.						



## EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-14 Ref# EMA2204/03/18

Rev.	01
Date	Jul 23

Ref.		Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
9.8	WM8	Store waste materials properly as follows:	To properly store waste	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94, EIAOTM
		- Avoid contamination by proper handling and storing waste		Contractor	construction	construction	phase	
		- Prevent erosion by covering waste			site	phase		
		- Apply water spray on excavated materials						
		- Maintain and clean storage area regularly						
		- Sort and stockpile different materials at designated location to enhance reuse						
9.8	WM9	Apply for relevant waste disposal permits in accordance with the Waste Disposal	To properly dispose waste	DSD's	Whole	Throughout	Construction	Waste Disposal Ordinance
		Ordinance (Cap. 354), Waste Disposal (Charges for Disposal of Construction Waste)		Contractor	construction	construction	phase	(Cap. 354), Waste
		Regulation (Cap. 345) and the Land (Miscellaneous Provisions) Ordinance (Cap. 28),			site	phase		Disposal (Charges for
		Dumping at Sea Ordinance (Cap. 466).						Disposal of Construction
								Waste) Regulation (Cap.
								345) and the Land
								(Miscellaneous
								Provisions) Ordinance
								(Cap. 28), Dumping at
								Sea Ordinance (Cap.
								466), EIAO-TM
9.8	WM10	Hire licensed waste disposal contractors for waste collection and removal. Dispose waste	To properly dispose waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		at licensed waste disposal facilities		Contractor	construction	construction	phase	Ordinance, EIAO-TM
					site	phase		
9.8	WM11	Implement trip-ticket system for recording the amount of waste generated, recycled and	To monitor movement of waste	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		disposed, including chemical wastes		Contractor	construction	construction phase	phase	Waste) (General)
					site	,		Regulation, Waste
								Disposal Ordinance,
								EIAO-TM
9.8	WM12	Provide wheel washing at construction site exit to clean the vehicle body and wheel	To prevent dust from being	DSD's	Whole	Throughout	Construction	ProPECC PN 1/94, EIAOTM
			brought offsite	Contractor	construction	construction phase	phase	
ļ					site	F.1322		
9.8	WM13	Reduce water content in wet spoil generated from piling work by mixing with dry	To minimize load to reception	DSD's	Whole	Throughout	Construction	Waste Disposal
		materials. Only dispose treated spoil with less than 25% dry density to Public Fill	facilities	Contractor	construction	construction phase	phase	Ordinance, EIAO-TM
		Reception Facilities			site	F		



### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

Monthly EM&A Report

# Page L-15 Ref# EMA2204/03/18 Rev. 01 Date Jul 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
9.8	WM14	Dispose dry waste or waste with less than 70% water content by	To minimize load to reception	DSD's	Whole	Throughout	Construction	Waste Disposal
		weight to landfill	facilities	Contractor	construction	construction	phase	Ordinance, EIAO-TM
					site	phase		
9.8	WM15	Follow the Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	To avoid accident in waste	DSD's	Whole	Throughout	Construction	Waste Disposal
		as follows:	storage and handling	Contractor	construction	construction	phase	Ordinance, EIAO-TM
		- Store chemical wastes with suitable containers. Seal and maintain the container to			site	phase		
		avoid leakage or spillage during storage, handling and transport						
		- Label chemical waste containers in both English and Chinese with instructions in						
		accordance to Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation						
		- The container capacity should be smaller than 450 litres unless agreed by the EPD						
9.8	WM16	Comply with the requirement of the chemical storage area:	To ensure proper storage of	DSD's	Whole	Throughout	Construction	Waste Disposal
		- Store only chemical waste and label clearly the chemical characters of the waste	chemical waste	Contractor	construction	construction	phase	Ordinance, EIAO-TM
		- Have at least 3 sides enclosed and protected from rainfall with cover			site	phase		
		- Provide sufficient ventilation						
		- Have impermeable floor and has bunds to contain 110% of the						
		capacity of the largest container or 20% of the total volume of						
		the stored waste in the area, whichever is larger						
		- Adequately spaced incompatible materials						
9.8	WM17	Transfer used lubricants, waste oils and other chemicals to oil recycling companies, if	To ensure proper disposal of	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		possible, and empty oil drums for reuse or refill. No direct or indirect discharge is	chemical waste	Contractor	construction	construction phase	phase	Waste) (General)
		permitted			site	pridoc		Regulation, EIAO-TM
9.8	WM18	Hire licensed chemical waste disposal contractors for waste collection and removal.	To ensure proper disposal of	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		Dispose chemical waste at the approved Chemical Waste Treatment Centre at Tsing Yi	chemical waste	Contractor	construction	construction phase	phase	Waste) (General)
		or other licensed facility			site	pridoo		Regulation, EIAO-TM
9.8	WM19	Hire reputable waste collector to separately collect and dispose general refuse from other	To ensure proper disposal of	DSD's	Whole	Throughout	Construction	Waste Disposal (Chemical
		wastes. Cover the waste to prevent being blown away	general refuse	Contractor	construction	construction phase	phase	Waste) (General)
					site	рпазо		Regulation, EIAO-TM



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-16 Ref# EMA2204/03/18 Rev. 01

Jul 23

Date

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant Legislation &	
Ref.	Ref.		Recommended Measure	Agent	the measure	the	stages	Guidelines	
			&			measure			
			Main Concerns to						
			address						
9.8	WM20	Provide recycling bins for sorting out recyclables for collection by recycling	To ensure proper recycling	DSD's	Whole	Throughout	Construction	Waste Disposal	
		companies. Non-recyclables should be removed to designated landfills	and	Contractor	construction	construction	phase	Ordinance, EIAO-TM	
		every day by licensed collectors to prevent environmental and health	disposal of general refuse		site	phase			
		nuisance.							
9.8	WM21	Organize training and reminders to site staff on waste minimization through	To ensure proper	DSD's	Whole	Throughout	Construction	EIAO-TM	
		avoidance and reduction, reusing and recycling	management	Contractor	Contractor	construction	construction	phase	
			of general refuse		site	phase			
9.8	WM22	Used bentonite shall be reconditioned onsite and reused as far as practical	To minimize wastage of	DSD's	Whole	Throughout	Construction	EIAO-TM	
		to minimize wastage. If this is deemed not viable, the used bentonite shall	bentonite	Contractor	construction	construction	phase		
		be delivered offsite for reconditioning.			site	phase			
9.8	WM23	Characterize the sediment quality of the marine sediment to be dredged and	To verify the categories of	DSD's	To be	Before	Construction	ETWB TC(W) No.	
		submit a Sediment Quality Report for EPD's approval. Dispose the dredged	sediment to be disposed in	Contractor	allocated	dredging works	phase	34/2002	
		marine sediment in accordance with ETWB TC(W) No. 34/2002	accordance with ETWB		by CEDD				
			TC(W)						
			No. 34/2002						



### EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O

Monthly EM&A Report

#### Page EMA2204/03/18 Ref# 01 Rev. Jul 23 Date

L-17

EIA Ref.	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
Dania at On	-:C- M							
Project Spe				1	_			
Table	CM8	Protective materials to be provided to natural rocky coastline to prevent damage to	To protect landscape resources	DSD's contractor	Temporary	Construction	Construction	Particular
10-6		existing landform from plant and machinery during temporary drilling operations.			drilling site for	planning and	phase	Specification
		Reinstatement following removal of plant & equipment to original or improved condition			submarine	during		
		shall be undertaken.			outfall	construction		
						period		
Table	OM1	Sensitive design of sewage treatment plant in terms of scale, height and bulk (visual	To mitigate visual impacts	DSD's Design	STP	Design Phase	Design Phase	Detailed Design
10-7		weight) to integrate the building into the existing topography.		Architect/ Engineer				Drawings
				Linginieei				and Specifications
Table	OM2	Use of appropriate building materials and colors for Sewage Treatment Plant to	To mitigate visual impacts	DSD's Design	STP	Design Phase	Design,	Detailed Design
10-7		complement surroundings		Architect/			Construction and	Drawings
				Engineer DSD's contractor	-	Construction	Operational	and Specifications
				DOD 6 contractor		Phase & first year	Phases	and opcomoducino
						in Operational	1 118303	
						Phase		
				Building Operator/DSD		Operational phase		
Generic/Sta	andard Mea	sures			l .	<u>u</u>	•	I.
Table	CM1	The construction area and contractor's temporary works areas should be minimized to	To avoid impact on adjacent	DSD's	STP, along	Construction	Construction	Detailed Design
10-6		avoid impacts on adjacent landscape. All slope excavation shall take place from within	landscape areas	Contractor	gravity sewers and rising	planning and	Phase	drawings
		the work boundary to minimize impacts on adjacent slopes.			mains	during		and particular
					construction	construction period		specifications
					route and at temporary			.,
					drilling site for			
					submarine outfall			
Table	CM2	Reduction of construction period to practical minimum	To minimize duration of impact	DSD's contractor	N/A	Construction	Construction	N/A
10-6	CIVIZ	Reduction of construction period to practical minimum	10 minimize duration of impact	DOD'S COMITACION	IN/A			IN/A
10-0						planning and	phase	
						during		
						construction		
						period		



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-18 Ref# EMA2204/03/18

	Kei#	LIVIA2204/03/10
Monthly EM&A Report	Rev.	01
	Date	Jul 23

EIA Ref.	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant Legislation &
	A Ref.		Recommended Measure &	Agent	the measure	measure	stages	Guidelines
			Main Concerns to address					
Table	CM3	Construction traffic (land and sea) including construction plant, construction vessels and	To minimize visual impacts to	DSD's	STP, along	Construction	Construction	As per the Particular
10-6		barges to be kept to a practical minimum.	local residents and surrounding	Contractor	gravity sewers	planning and	phase	Specification
			VSRs		and rising	during		
					mains	construction		
					construction	period		
					route at			
					temporary			
					drilling and			
					dredging sites			
					for submarine			
					outfall			
Table	CM4	Erection of decorative mesh screens or construction hoardings and/or temporary noise	To screen construction works	DSD's	STP, along	Construction	Construction	As per the Particular
10-6		barriers around works areas in visually unobtrusive colors.	from local residents and	Contractor	gravity sewers	planning and	phase	Specification
			surrounding VSRs		and rising	during		
					mains	construction		
					construction	period		
					route and at			
					temporary			
					drilling site for			
					submarine			
					outfall			
Table	CM5	Avoidance of excessive height and bulk of site buildings and structures.	To reduce visual impact	DSD's	STP, and at	Construction	Construction	As per the Particular
10-6				Contractor	temporary	planning and	phase	Specification
					drilling site for	during		
					submarine	construction		
					outfall	period		
Table	CM6	Control of night-time lighting by hooding all lights and through minimization of night	To maximize screening of the	DSD's	STP and at	Construction	Construction	As per the Particular
10-6		working periods.	works	Contractor	temporary	planning and during	phase	Specification
					drilling and	construction		
					dredging site	period		
					for submarine			
					outfall			



#### L-19 Page EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O EMA2204/03/18 Ref# 01 Rev.

Jul 23

Date

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant Legislation &
Ref.	A Ref.		Recommended Measure	Agent	the measure	the	stages	Guidelines
			&			measure		
			Main Concerns to					
			address					
Table	CM7	All existing trees shall be carefully protected during construction. A Detailed	To maximize protection of	DSD's	STP and all	Construction	Construction	As per Tree Protection
10-6		Tree Protection Specification shall be provided in the Contract Specification.	existing trees	Contractor	other	planning and	phase	Particular Specification,
		Under this specification, the Contractor shall be required to submit, for			construction	during		DEVB TC (W)
		approval, a detailed working method statement for the protection of trees			areas	construction		No.10/2013 and
		prior to undertaking any works adjacent to all retained trees, including trees				period		Guidelines for Tree Risk
		in contractor's works areas. Tree risk assessment shall be undertaken to all						Assessment and
		existing trees within the project site as per "Guidelines for Tree Risk						Management
		Assessment and Management Arrangement"						Arrangement
Table	OM3	Lighting units to be directional and minimize unnecessary light spill and	To mitigate visual impacts	DSD's Design	STP	Design Phase	Design,	Detailed Design
10-7		glare.		Architect/ Engineer			Construction and	Drawings
				DSD's contractor		Construction	Operational	and Specifications
						Phase & first	Phases	
						year		
						in Operational		
						Phase		
				Building		Operational		
				Operator/DSD		phase		
Table	OM4	Greening measures to reinstate the landscape which are appropriate to the	To mitigate visual impacts	DSD's Design	STP	Design Phase	Design,	Detailed Design
10-7		context, including tree and shrub planting and vertical greening, shall be		Landscape Architect			Construction and	Drawings
		implemented.		DSD's contractor	1	Construction	Operational	and Specifications
						Phase & first	Phases	
						year		
						in Operational		
						Phase		
				Building		Operational		
				Operator/DSD		phase		



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-20 Ref# EMA2204/03/18 Rev. 01 Date Jul 23

EIA	EM &	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of	Implementation	Relevant Legislation &
Ref.	A Ref.		Recommended Measure	Agent	the measure	the	stages	Guidelines
			&			measure		
			Main Concerns to					
			address					
Table	OM5	Compensatory tree planting for all felled trees shall be provided to the	To mitigate landscape and	DSD's	STP and at	Design Phase	Design,	As per approved Tree
10-7		satisfaction of relevant Government departments. Required numbers and	visual impacts of tree loss	Landscape Architect	temporary		Construction and	Removal Application,
		locations of compensatory trees shall be determined and agreed separately		7 61 661	drilling site for		Operational	Detailed Design
		with Government during the Tree Felling Application process under the		Contractor's	submarine	Construction	Phases	Drawings, Tree
		relevant technical circulars. Tree risk assessment shall be undertaken to all		Landscape Architect	outfall	Phase & first		Protection
		existing trees within the project site as per "Guidelines for Tree Risk		7 61 661		year		Particular Specification
		Assessment and Management Arrangement"				in Operational		and Guidelines for Tree
						Phase		Risk Assessment and
				Building	1	Operational		Management
				Operator/DSD		phase		Arrangement



## EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page L-21 Ref# EMA2204/03/18

Rev.	01
Date	Jul 23

EIA	EM & A	Recommended Mitigation Measures *	Objectives of the	Implementation	Location of	Duration of the	Implementation	Relevant
Ref.	Ref.		Recommended Measure &	Agent	the measure	measure	stages	Legislation &
			Main Concerns to address					Guidelines
Built He	eritage							
Project	Specific Me	asures						
11.6	BH1	Undertake condition survey by professional qualified building surveyor or	To record the condition of the	DSD's	GB01, BH02,	Before	Construction	EIAO-TM and
		engineer to record the existing condition of the built heritage resources.	built heritage resources before	Contractor	LF04	commencement	Phase	Guidelines
			the commencement of			of		for CHIA
			construction works			construction		
						works		
11.6	BH2	Carry out vibration and settlement monitoring to built heritage resources. A	To minimize the potential	DSD's	GB01, BH02,	During	Construction	EIAO-TM and
		maximum vibration level 7.5mm/s shall be adopted for the Grade 3 Hung	impact by mechanical vibration	Contractor	LF04	construction	phase	Guidelines
		Shing Temple and settlement check points in the Alert/Alarm/Action limit	and settlement of built heritage			works		for CHIA
		levels at 6mm/8mm/10mm shall be adopted.	resources					
11.6	BH3	Provision of protective covering or protective screen to built heritage	To prevent direct impact from	DSD's	GB01, BH02,	During	Construction	EIAO-TM and
		resources which are close to the works area	the machine and damages by	Contractor	LF01, LF04	construction	phase	Guidelines
			construction tools or waste			works		for CHIA
11.6	BH4	Maintain public access to the cultural landscape features as far as possible	To avoid the proposed works	DSD's	LF01, LF04,	During	Construction	EIAO-TM and
			affecting the worshippers	Contractor	LF05	construction	phase	Guidelines
						works		for CHIA
11.6	BH5	Provision of buffer zone of at least 1m from the proposed works as far as	To avoid the proposed works	DSD's	BH02, LF01,	During	Construction	EIAO-TM and
		possible	affecting the worshippers	Contractor	LF04	construction	phase	Guidelines
						works		for CHIA

<sup>\*</sup> All recommendations and requirements resulted during the course of EIA Process, including ACE and/or accepted public comment to the proposed proj



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	M-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report		01
	Date	Jul 23

# APPENDIX M - RECOMMENDED MITIGATION MEASURES AND PROACTIVE ENVIRONMENTAL PROTECTION PROFORMA



# EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O Page M-2 Ref# EMA2204/03/18 Rev. 01 Date Jul 23

Reporting Period: 2023-06-01 - 2023-06-30

Construction Works Area: PTO-SW-03, PTO-Trenchless -01& STP

Anticipated Impacts: Dust, Noise, Water Quality, Terrestrial Ecology, Marine Ecology, Fisheries, Waste Management, Landscape and Visual and Build Heritage Impact

Item	EIA Ref.	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
		Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Air	3.8	A10 -	a) Major air quality impact in construction phase	a) All construction plants / machineries will be	(a) Hoarding of not less than 2.4 m high shall be erected from	Contractor	a) 1-hour and 24-hour TSP levels will be
Quality		A25	would arise from excavation of slope at the	checked / serviced on a regular basis during the courses	ground level to surround the work area along Po Toi O Chuen		measured in accordance to the standard
Impact			proposed sewage treatment plant.	of construction to minimize the emission of noise	Road except for a site entrance or exit.		high-volume sampling method as set out in
				generation and eliminate dark smoke emission.			the Title 40 of the Code of Federal
			b) Excavation, Gas welding, slope cutting, Rock		(b) Good housekeeping to minimize dust generation, e.g. by		Regulations, Chapter 1 (Part 50), Appendix
			dowel, fencing, flexible barrier installation Loading	b) All dump trucks will be equipped with mechanical covers	properly handling and storing dusty materials.		A.
			& Unloading Dusty Materials storage, Dusty	to prevent the dust emission during transportation when			
			Waste Sorting, Temporary Site Traffic Control	necessary.	(c) Adopt dust control measures, such as dust suppression		b) Due to objection from the residents of Po
					using water spray on exposed soil at least 4 times a day, in		Toi O village of the use of high-volume
				c) Dust control measures, such as water spraying, will be	areas with dusty construction activities and during material		sampler (HVS) in conducting 24-hours TSP
				provided during demolition works when necessary.	handling.		measurement, 24-hour TSP measures for
							impact monitoring is to be measured by
				d) Maintaining of wet surface on access road and keep	d) Minimize exposed earth after completion of work in a		portable dust meters during construction
				slow speed in the site.	certain area by hydroseeding, vegetating, soil compacting or		phase of the project. This is to be approved
					covering with bitumen.		and verified by ER and IEC.
				e) Conditions in the Environmental Permit			
				and Discharge License should be followed.	(e) Provide wheel washing at site exit to prevent carrying		c) Other than using high volume sampler, 1-
					dust outside of the site.		hour TSP levels can be measured
				f) Predict required quantity of concrete			alternatively by direct reading from portable
				accurately and collect the unused fresh	(f) Cover materials on trucks before leaving the site.		dust meters upon approval from ER. The
				concrete at designated locations in the site for			meters should be capable of producing
				subsequent disposal.	(g) Limit vehicle speed of construction trucks within the		comparable results as that by the high-
					construction site and in Po Toi O, maximum at 10km/hr, and		volume sampling method, to indicate short
				g) Provide sufficient mitigation measures as	confine vehicle movement in haul road.		event impacts.
				recommended in approved EIA Manual requirement.			
					(h) As there is limited space in Po Toi O, stockpiling should		d) -The ET shall agree with the IEC on the
					be avoided. However, if found necessary, the materials		monitoring position and the corrections
					should be covered by impervious materials such as tarpaulin.		adopted.
							e) -The agreed position shall be chosen in
							subsequent baseline and impact
							monitoring.



Page	M-3
Ref#	EMA2204/03/18
Rev.	01
Date	lul 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Noise	4.7	N1 -	a) The Project comprises three main	a) Conditions in the Environmental Permit and		Contractor	a) Noise measurement shall normally
Impact		N175	works including the construction of	Discharge License should be followed.			be at a point 1 m from the exterior of
Control			sewage treatment plant (STP),				the sensitive receiver building façade
			underground sewers and rising main, and	b) Provide sufficient mitigation measures as			and be at a position 1.2 m above the
			the submarine outfall.	recommended in approved EIA Manual			ground. If the normal monitoring
				requirement.			position cannot be accessed, an
			b) The major noise impact will arise from				alternative position may be chosen,
			the use of powered mechanical				and a correction to the
			equipment.				measurements shall be made. For
							reference, a correction of +3 dB(A)
			c) Excavation, Gas welding, slope cutting,				shall be made to the free field
			Rock dowel, fencing, flexible barrier				measurements.
			installation Loading & Unloading Dusty				
			Materials storage, Temporary Site Traffic				b) The ET shall agree with the IEC on
			Control.				the monitoring position and the
							corrections adopted.
1							
							c) The agreed position shall be
							chosen in subsequent baseline and
							impact monitoring.



	Page	M-4
	Ref#	EMA2204/03/18
	Rev.	01
	Date	Jul 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Water	5.8	W1-	a) Major Water quality impact will be	a) Wastewater to be treated by wastewater	a) Well manage construction materials, chemicals,	Contractor	a) Weekly site audit to monitor the
Quality		W33	originated from minor displacement of	treatment facilities before discharge.	sewage for proper storage and usage and to prevent		implementation of the proposed water
impact			suspended solids during installation,		accumulation onsite.		quality mitigation measures and
			testing pipe and extraction of cofferdam	b) Conditions in the Environmental Permit and	(b) Immediately clean up contaminated soil upon		check the Contractor's work practice
			around the proposed diffuser.	Discharge License should be followed.	chemical and oil leakage.		on water pollution prevention during
					(c) Label chemical waste containers according to the		construction phase.
					Code of Practice to notify and warn the waste		
					handlers. Store fuels, chemicals and chemical waste		b) Should water pollution is observed
					at designated area with locks and bunds.		(e.g. discharge of silty water into
					(d) Register as chemical waste producer.		storm drains), the ET should record
					(e) Set up sedimentation tank for settling suspended		the environmental deficiency for
					solids in wastewater before discharge into storm		investigation.
					drains. Sand/silt removal facilities such as sand		
					traps, silt traps and sedimentation basin should be		c) The Contractor should be notified
					provided with adequate capacity.		and responsible for carrying out
					(f) Provide sufficient number of chemical toilets if		rectification work immediately.
					necessary and employ licensed contractor for		
					regular clean-up and maintenance.		d) The ET shall re-inspect the Project
					(g) Provide wheel washing at site exit to prevent dust		Site and review the effectiveness of
					and silty water from leaving the construction site.		the remedial measure performed until
					(h) Cover slope and loose materials with tarpaulin		satisfaction.
					before rainstorm and inspect the area afterwards.		
					(i) Cover manhole to prevent silt, construction		e) The Contractor shall implement
					materials or debris and surface runoff from entering		preventive measure to avoid causing
					the foul sewer.		the same problem.
					(j) Install fully enclosed cofferdam around the		
					proposed diffuser and deploy a dredger barge		
					outside the cofferdam for dredging and filling works.		



Page	M-5
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Terrestrial	6.12	E1-E8	a) The proposed Project will cause minor	a) Conditions in the Environmental Permit and	a) Construction noise and water quality mitigation	Contractor	(a) Bright colour fencing shall be
Ecology			habitat loss of shrubland, temporary	Discharge License should be followed.	measures proposed in the previous sections will be		erected along the boundary of the
			habitat loss of woodland, developed area		applicable to terrestrial ecology.		undisturbed region of the shrubland
			and rocky shore, and removal of one	b) Provide sufficient mitigation measures as			and woodland, and around Diospyros
			individual climber species of conservation	recommended in approved EIA Manual			vaccinioides, a plant species of
			importance that is common within the	requirement.			conservation importance, near the
			Study Area and Hong Kong. Indirect				work boundary to remind workers not
			water quality impact may arise from				to trespass or occupy the area, and
			surface runoff or accidental spillage of				to be careful during operation of
			chemicals in construction Phase.				equipment.
			b) Use of powered plant equipment may				(b)Inspect the condition of Diospyros
			bring noise disturbance on wildlife				vaccinioides as part of weekly site
							audit.
							(c) Reinstate the disturbed rocky
							shore with the rocks temporarily
							removed.
							(d) Carry out compensatory tree
							planting in accordance with DEVB
							TCW No. 7/2015 to reinstate the
							affected woodland.



Page	M-6
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Marine	7	7	a) The proposed Project will cause minor	a) Conditions in the Environmental Permit and	a) The variation in water quality at coral and	Contractor	(a) No specific monitoring and audit
Ecology			habitat loss of muddy seabed.	Discharge License should be followed	amphioxus habitats during cofferdam installation		programme is required. With proper
					and extraction works will be overseen by water		implementation of water quality
			b) Indirect water quality impact may arise		quality monitoring mentioned.		mitigation measures, residual impact
			from installation and extraction of sheet				is expected to be acceptable.
			pile of cofferdam in construction phase.				
			c) Dredging and backfilling for installation				
			of diffuser will be conducted inside fully				
			enclosed cofferdam. No marine sediment				
			loss to water column is expected.				



#### 

Page

M-7

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Fisheries	8	8	a) No direct encroachment on Fish Culture	a) Conditions in the Environmental Permit and	Water quality at FCZ will be monitored during	Contractor	(a) No specific monitoring and audit
			Zone and Artificial Reefs in the Study Area	Discharge License should be followed	cofferdam installation and extraction works and		programme are required. With proper
			is expected.		dredging works in the construction phase as		implementation of water quality
					proposed.		mitigation measures, residual impact
			b) About 1,920 m2 of fishing ground and				is expected to be acceptable.
			500 m2 of benthic spawning ground will be				
			affected. Except the 5 m2 benthic				
			spawning ground will be lost permanently,				
			other impacted area will only be affected in				
			construction phase temporarily (reversible				
			impact). Indirect impact on fisheries				
			resources by the water quality				
			deterioration will be insignificant with				
			proper implementation of water quality				
			mitigation measures.				



	Page	M-8
	Ref#	EMA2204/03/18
	Rev.	01
	Date	Jul 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Waste	9.8	WM4-	a) Construction of the sewage	a) All C&D materials generated will be	(a) Reuse C&D materials onsite and dispose excess	Contractor	The Contractor should apply for relevant
Management		WM23	treatment plant, laying of gravity	transported and stored at temporary	uncontaminated ones to public fill.		licenses/permits for waste disposal under
			sewers and rising mains and	storage area. Cover will be provided			different regulations and ordinances as
			submarine outfall are expected to	during transportation of dusty materials.	(b) Provide sufficient waste collection points for general		follows:
			generate mainly inert construction	Suitable materials will be sorted for	refuse and regularly maintained to avoid accumulation.		(a) Chemical Waste Permits/licenses
			and demolition (C&D) materials	reuse on-site. Only non-inert C&D	Dispose the waste at waste transfer or disposal facilities.		under the Waste Disposal Ordinance
			(or public fill) from excavation,	material will be disposed offsite to NENT			(Cap 354);
			and unused building materials.	Landfill.	(c) Minimize wastage through careful planning and avoiding		
			Other wastes include noninert		over purchase of construction materials.		(b) Public Dumping License under the
			C&D materials (or C&D waste),	b) Conditions in the Environmental			Land Miscellaneous Provisions)
			plant materials, scaffolding,	Permit and Discharge License should be	(d) Provide training to workers on site cleanliness, waste		Ordinance (Cap 28);
			formwork and packaging,	followed	management (waste reduction, reuse and recycle) and		
			chemical waste from plant		chemical handling procedures.		(c) Marine Dumping Permit under
			maintenance, bentonite slurry	c) Fueling of equipment will be			Dumping at Sea Ordinance (Cap 466); and
			from drilling works and general	conducted carefully onsite by mobile	(e) Hire licensed waste disposal contractors for waste		
			refuse from workers.	tanker to avoid storage of fuel and oil	collection and removal. Dispose waste at licensed waste		(d) Effluent Discharge License under the
				spillage.	disposal facilities.		Water Pollution Control Ordinance (Cap
			b) Dredging at the proposed				358).
			diffuser location will generate	d) Provision of drip trays for equipment	(f) Recondition and reuse bentonite as far as practical.		
			marine sediment.	likely cause spillage of chemical / fuel			b) Reference should be made to EPD's
				and provide routine maintenance.	(g) Conduct marine sediment test and dump dredged marine		booklets on licenses/permits. The
					sediment according to ETWB TCW No. 34/2002		Contractor shall also document recycling
					Management of Dredged/Excavated Sediment and Dumping		receipts/ disposal record to keep track of
					at Sea Ordinance.		waste movement. The ET shall check with
							the Contractor that these licenses/permits
					(h) Chemical waste shall be handled, stored and disposed		have been obtained. He should also
					properly, according to the relevant guidelines.		review the above documentations
							regularly to ensure compliance with
							legislations and specifications.



Page	M-9
Ref#	EMA2204/03/18
Rev.	01
Date	Jul 23

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Landscape	Table	CM1-	a) Minor landscape and visual	a) Conditions in the Environmental	a) The contractor shall employ a professionally qualified	Contractor	a) Tree risk assessment shall be
and Visual	10-6	CM8	impact is expected due to	Permit and Discharge License should	Registered Landscape Architect (RLA) on the Environmental		undertaken by the contractor during
impact	& 10-	&	dredging work in open sea,	be followed.	Team to supervise and monitor the implementation of		construction to all existing trees within the
	7	OM1-	construction of the STP and		construction phase landscape and visual mitigation		project site as per "Guidelines for Tree
		OM5	pipelines on land and the loss of	b) Implement the recommended	measures. This is necessary to ensure that all the		Risk Assessment and Management
			existing trees and vegetation at	mitigation proposed in EM&A manual.	recommended landscape and visual mitigation measures		Arrangement".
			the sewage treatment plant site in		under Chapter 10 of the EIA are effectively implemented		
			the construction phase.		including minimization of the works footprint, ensuring that		b) Site inspections by appointed RLA shall
					those existing trees earmarked for retention on site or		be undertaken at monthly intervals to
					transplanting are protected and planting works are correctly		closely monitor all these aspects of work.
					implemented.		Inspection findings shall be logged in a site
							monitoring report with any discrepancies
							or concerns regarding the implementation
							and effectiveness of mitigation measures
							highlighted.
	1						



#### 

M-10

Page

Item	EIA	EM&A	Environmental	Corresponding	EM&A Manual	Action By	Measurement
	Ref.	Ref.	Aspect	Mitigation Measures	Recommended Mitigation/		Procedures/Methods
					Actions		
Build	11.6	BH1 -	a) As the proposed work is close	a) Conditions in the Environmental	a) Provision of protective covering or protective screen is	Contractor	a) A maximum vibration level of 7.5mm/s
Heritage		BH5	to some of the identified built	Permit and Discharge License should	recommended to identified built heritage to prevent damages		shall be adopted for the Grade 3 Hung
			heritage resources, condition	be followed.	by construction tools or waste.		Shing Temple and settlement check points
			survey, vibration and settlement				in the Alert/Alarm/Action limit levels at
			monitoring is recommended to	b) Implement the recommended	b) Maintenance of public access is suggested for identified		6mm/8mm/10mm shall be adopted.
			identified built heritage to prevent	mitigation proposed in EM&A manual.	built heritage. Besides, buffer zone of at least 1m from the		
			indirect damage by mechanical		works boundary should be provided for identified built		
			vibration and settlement.		heritage as far as possible.		
					c) Condition survey, vibration and settlement monitoring to		
					identified built heritage.		
					identified ball fromage.		



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage	Page	N-1
Works at Po Toi O	Ref#	EMA2204/03/18
Monthly EM&A Report	Rev.	01
	Date	Jul 23

## APPENDIX N - CUMULATIVE STATISTICS ON COMPLAINTS, NOTIFICATIONS OF SUMMONS



EP-516/2016 - Port Shelter Sewerage, Stage3 - Sewerage Works at Po Toi O	Page	N-2
EP-516/2016 - Port Sheiter Sewerage, Stages - Sewerage Works at Po 1010	Ref# Rev.	EMA2204/03/18
Monthly EM&A Report	Rev.	01
Monthly Linux Report		Jul 23

#### **Environmental Complaints Log**

Complaint	Date of	Received	Received	Nature of	Relevant to the Construction Work of	Investigation/	Status
Log No.	Complaint	From	Ву	Environmental		Mitigation	
				Complaint	Project Site? (Y/N)	Action	
001	28	EPD	ET	Waste	N	The	Closed
	December			Management		investigation	
	2021					reports	
						was submitted	
						on 7 January	
						2022	

#### Remark:

### Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions and Public Engagement Activities

Reporting Period	Complaints	Notifications of Summons and	Public Engagement Activities	
		Prosecutions		
This Month	0	0	0	
Cumulative Project-to-Date	1	0	0	

<sup>\*</sup> No complaints, Notifications of Summons, or Successful Prosecutions were received in the reporting period.