# China Resources Construction Company Limited MAUNSELL AECOM

Contract No. SS M333

## Reprovisioning of Diamond Hill Crematorium

Monthly EM&A Report for June 2006

July 2006

	Name	Signature	
Reviewed & Checked:	Florence Yuen	Florence Ynen	
Approved: (ET Leader)	Y T Tang	Teghtoling	

Version:	Revision 0	Date:	14 July 2006
recommendations in the report upon the information that was	t are based on our experience, us available to us. These interpretation	ing reasonable professions and recommendations	of printing. The interpretation and nal skill and judgment, and based are not necessarily relevant to any or the sole and specific use of our

This report is copyright and may not be reproduced in whole or in part without prior written permission.

## MAUNSELL ENVIRONMENTAL MANAGEMENT CONSULTANTS LTD

11/F, Grand Central Plaza, Tower 2, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong Tel: (852) 2893 1551 Fax: (852) 2891 0305 Email: <a href="mailto:mem@maunsell.aecom.com">mem@maunsell.aecom.com</a>

client and MEMCL accepts no responsibility for its use by others.

·	



Consulting

安誠工程顧問有限公司

香港灣行

皇后大道東183號

合和中心 47 性

抵: (852) 2911 2283 強文傳真: (852) 2805,5028

電子郵稿: hyder.hk@hyderconsulting.com 址: www.hyderconsuiting.com

Hyder Consulting Limited

47/F Hopewell Centre. 183 Queen's Road East, Wan Chai, Hong Kong

Tel: (852) 2911 2233 Fax : (852) 2805 5028

BY POST: & FAX (2524 8194)

1148-06/E06-36856

Email: hyder.hk@hyderconsulting.com Website: www.hyderconsulting.com .

Hyder Consulting Limited is incorporated in Hong Kong with limited liability. COI Number 126012

Your

Rof:

Our

Ref:

12 July 2006

Architectural Services Department Queensway Government Offices 66 Queensway

Hong Kong

For attention of: Mr Michael Mak

Dear Michael

Reprovisioning of Diamond Hill Crematorium Monthly EM&A Report for June 2006 (Revision 0)

We refer to the emails of 12 July 2006, which was copied to us, with the enclosure of the draft monthly EM&A Report for June 2006 (Revision 0) from MEMCL and telephone conversation between Fiona Li of MEMCL and our Adi Lee on 14 July 2006.

We have no comment and hereby verified the captioned EM&A report.

Should you have any queries, please do not hesitate to contact the undersigned on 2911 2719 or Adi Lee on 2911 2729.

Yours sincerely:

Coleman Ng

Independent Environmental Checker

HYDER CONSULTING LIMITED

MEMCL - Mr. Y. T. Tang/Ms Florence Yuen CC

CRCCL - Mr. Eric To

(Fax: 2891 0305) (Fax: 2827 2921)

CN/AL



## **TABLE OF CONTENTS**

EXE	CUTIVE SUMMARY	11
1.	INTRODUCTION	1
	Background	1 1 1
2.	AIR QUALITY	
	Monitoring Requirements	
3.	NOISE	£
	Monitoring Requirements	5 5 6
4.	ENVIRONMENTAL SITE INSPECTION	7
	Site Inspections	7 8 8
5.	FUTURE KEY ISSUES	9
	Key Issues and Recommendations for Coming Month Environmental Monitoring and Audit Schedule for the Coming Months	9
6.	CONCLUSIONS AND RECOMMENDATIONS	ç
	Conclusions	

	of Diamond Hill Crematorium Report for June 2006 (Revision 0)
IVIOITINY ENIGH	Treport for duric 2000 (Trevision 0)
List of Tables	
Table 2.1	Air Quality Monitoring Equipment2
Table 2.2	Air Quality Monitoring Parameters, Frequency and Duration
Table 2.3	Locations of Air Quality Monitoring Stations
Table 2.4	Summary of Impact 1-hour TSP Monitoring Results4
Table 2.5	Summary of Impact 24-hour TSP Monitoring Results
Table 3.1	Noise Monitoring Equipment5
Table 3.2	Noise Monitoring Parameters, Frequency and Duration5
Table 3.3	Locations of Noise Monitoring Stations6
Table 3.4	Summary of Impact Noise Monitoring Results during 07:00 – 19:00 on Normal Weekdays 7
Table 4.1	Summary of Waste Disposal in the Month8
Table 4.2	Summary Of Environmental Complaints And Prosecutions9
List of Figures	
Figure 1.1	Project Organisation for Environmental Management
Figure 1.2	Layout of Work Site
Figure 2.1	Locations of Air Quality Monitoring Stations
Figure 3.1	Locations of Construction Noise Monitoring Stations
Figure 4.1	Complaint Flow Diagram
Appendices	
Appendix A	Key Contacts of Environmental Personnel
Appendix B	Construction Programme
Appendix C	Environmental Action and Limit Levels
Appendix D	Environmental Monitoring and Audit Schedules
Appendix E	Calibration Details
Appendix F	Air Quality Monitoring Results and Graphical Presentation
Appendix G	Noise Monitoring Results and Graphical Presentation
Appendix H	Summary of Weekly Environmental Site Inspection Observations
Appendix I	Status of Environmental Permits/Licences
Appendix J	Implementation Schedule of Mitigation Measures
Appendix K	Event and Action Plans
• •	
•	

#### **EXECUTIVE SUMMARY**

#### Introduction

Maunsell Environmental Management Consultants Limited (MEMCL) is the designated Environmental Team (ET) for "Reprovisioning of Diamond Hill Crematorium" (The Project). This is the twentieth monthly Environmental Monitoring and Audit (EM&A) report prepared by MEMCL for the Project. The EM&A programme for the Project commenced on 29 October 2004. This report documents the findings of EM&A Works conducted in the month of June 2006 (1 to 30 June 2006).

As informed by the Contractor, construction activities in the reporting period were:

- · Backfilling of soil and compaction;
- Steel fixing, erect formwork and concreting for footings, internal and external walls (including fair-face concrete wall), columns and slabs;
- · Welding/dismantling of steel waling and strutting to sheet pile / pipe pile wall;
- Transportation and installation of E&M components for cremator at Cremator Plant Room;
- · Erection of Steel Platform at G/F of Cremator Plant Room; and
- Internal Plastering Works at L/G Floor Rooms.

A summary of monitoring and audit activities conducted in the reporting period is listed below:

1-hour TSP monitoring	15 sessions
24-hour TSP monitoring	6 sessions
Daytime noise monitoring	5 sessions
Environmental site inspection	5 sessions

#### **Breaches of Action and Limit Levels**

#### Air Quality

All 1-hour and 24-hour TSP monitoring results recorded in the month complied with the Action and Limit Levels.

#### **Construction Noise**

All noise monitoring results recorded in the month complied with the Action and Limit Levels.

#### Implementation Status of Environmental Mitigation Measures

In general, the Contractor satisfactorily implemented all the required mitigation measures and was reasonably responsive to the ET's recommendations on any discrepancy observed during the weekly environmental site inspection.

#### Environmental Complaints, Notification of Summons and Successful Prosecutions

No environmental complaint, notification of summons or successful prosecution was received or made against this Project in the month.

#### Reporting Changes

No reporting change was required in the month.

#### **Future Key Issues**

Key issues to be considered in the coming month include:

- Generation of dust from activities on-site;
- Noise impact from operating equipment and machinery on-site;

Reprovisioning of Diamond Hill Crematorium  Monthly EM&A Report for June 2006 (Revision 0)
<ul> <li>Generation of site surface runoffs and wastewater from activities on-site;</li> <li>Storage and disposal of general refuse and construction waste from activities on-site;</li> <li>Management of chemicals and avoidance of oil spillage.</li> </ul>
摘要
簡介
茂盛環境管理顧問有限公司乃「重置鑽石山火葬場」[下稱(工程項目)] 的指定環境小組。本冊是茂盛爲工程項目製作的第二十份每月環境監察及審核報告。工程項目的環境監察及審核由二零零四年十月廿九日開始、本報告記錄了二零零六年六月份(二零零六年六月一日至六月三十日)所進行的環境監察及審核工作。
根據承建商的資料,本月有以下的建築活動:
<ul> <li>泥土回填及壓緊</li> <li>鋼根固定,支架構成及混凝土澆灌</li> <li>把鋼支腰樑焊接或拆卸於椿上</li> <li>把電機結構運送至及安裝於焚化爐機房的焚化爐上</li> <li>豎立鋼鐵台架於焚化爐機房地面</li> <li>地面內牆噴上砂漿</li> </ul>
本月有下列幾項的監察及審核活動:  一小時總懸浮粒子監察 15 次  廿四小時總懸浮粒子監察 6 次 日間噪音監察 5 次 環境巡查 5 次
違反監察標準
空氣質素 本月所有一小時及二十四小時總懸浮粒子監測結果皆符合行動水平和極限水平。
建築噪音 本月所有噪音監測結果皆符合行動水平和極限水平。
環境影響緩和措施
承建商大致上完成所需的緩和措施,同時已對環境小組在每週的環境巡查中的建議作出合理的回應及跟進。
有關環境的投訴,傳票及檢控
本月沒有收到有關環境的投訴,傳票及檢控。
報告修訂
本月並沒有修訂報告。
預計要注意的事項
下月要注意事項包括: -工程活動所產生的塵埃 -操作中儀器及機器產生的噪音影響 -工程活動所產生的污水

Reprovisioning of Diamond Hill Crematorium Monthly EM&A Report for June 2006 (Revision 0)

- 一普通廢物與建築廢物的暫貯及棄置 一化學品的管理及防止意外漏油

#### 1. INTRODUCTION

## Background

1.1 Maunsell Environmental Management Consultants Limited (MEMCL) (hereinafter called the "ET") was appointed by China Resources Construction Company Limited (CRC) (hereinafter called the "Contractor") to undertake Environmental Monitoring and Audit for "Reprovisioning of Diamond Hill Crematorium" (hereinafter called the "Project"). Under the requirements of Section 4 of Environmental Permit EP-179/2004, EM&A programme as set out in the approved EM&A Manual is required to be implemented. In accordance with the approved EM&A Manual, environmental monitoring of air quality and noise and environmental site inspections are required for the Project.

## Scope of Report

1.2 The EM&A programme for the Project commenced on 29 October 2004. This report presents a summary of the environmental monitoring and audit works, list of activities, and mitigation measures for the Project in June 2006 (from 1 to 30 June 2006).

## **Project Organisation**

1.3 The organisation of the environmental management team is shown in Figure 1.1. Key personnel contacts are presented in Appendix A.

#### **Environmental Status in the Reporting Month**

- 1.4 The construction programme of the Project is provided in Appendix B. In the month, the following activities took place for the construction of the Project:
  - Backfilling of soil and compaction;
  - Steel fixing, erect formwork and concreting for footings, internal and external walls (including fair-face concrete wall), columns and slabs;
  - Welding/dismantling of steel waling and strutting to sheet pile / pipe pile wall;
  - Transportation and installation of E&M components for cremator at Cremator Plant Room;
  - · Erection of Steel Platform at G/F of Cremator Plant Room; and
  - Internal Plastering Works at L/G Floor Rooms.
- 1.5 Layout plan of the Project work site is provided in Figure 1.2.

## Summary of EM&A Requirements

- 1.6 The description and detailed locations of sensitive receivers and monitoring stations for air quality and noise are shown in Figures 2.1 and 3.1 respectively and relevant sections of this Report.
- 1.7 The EM&A programme require environmental monitoring for air quality and noise and environmental site inspections for air quality, noise, water quality, landscape and visual, and waste management. The EM&A requirements for each parameter described in the following sections include:
  - All monitoring parameters
  - Action and Limit Levels for all environmental parameters
  - Event and Action Plans
  - Environmental mitigation measures, as recommended in the project final EIA report
  - Environmental requirements in contract documents.

ovisioning of Diam nly EM&A Report f	ond Hill Cremator or June 2006 (Re		
		on status of environr endix J of the Report	nental protection and pollution control/mitigation
AIR QUALIT	Y		
Monitoring Re	quirements		
month in accor	d 24-hour TSP led dance with the E nvironmental mot	M&A Manual. Appe	ated monitoring stations were monitored in the endix C shows the established Action and Limit
		e month is shown in easurements are sho	Appendix D. Air quality monitoring stations for own in Figure 2.1.
Monitoring Eq	uipment		
Model GMWS- hour TSP samp	2310 Accu-Vol) oling. The HVS m	completed with the a eet all the requireme	TSP monitoring. High volume sampler (HVS - appropriate sampling inlets was installed for 24-ents as specified in the approved EM&A Manual. In the dust-monitoring programme.
Table 2.1		nitoring Equipment	
Equipment	Мо	del	
Dust Meter (fo TSP measure	ment 1/L	ser Dust Monitor – M D-3	odel LD-
HVS (for 24-h measurement	1 ( 1)	IWS 2310 Accy-Vol	system
Calibration Kit		1W 25	
Monitoring Pa	rameters, Frequ	ency and Duration	
Table 2.2 sum monitoring.	marised the mo	nitoring parameters	, frequency and duration of impact air quality
Table 2.2	Air Quality Mo	nitoring Parameters	s, Frequency and Duration
Parameter	Durati		equency
1-hour TSP	1 hour 24 hou		imes every six days nce every six days
24-hour TSP  Monitoring Lo		113   [0]	ioc cycly six days
monitoring LO	outivita		
In accordance were selected quality monitor	for 24-hour TSP	Manual, two air qua and 1-hour TSP san	lity monitoring stations, as shown in Figure 2.1 apling. Table 2.3 describes the location of the air
Table 2.3	•	ir Quality Monitorir	ng Stations
Monitoring Station	Identity / Desci	ription	Level
ASR8	Po Leung Kuk ( School	Grandmont Primary	Roof top level of 7 storey building

ASR17	Staff Quarter for Diamond Hill	Roof top level of 1 storey building
ASKII	Crematorium	

#### **Monitoring Methodology**

## 1-hour TSP Monitoring

Monitoring Procedure

- 2.6 The measuring procedures of 1-hour TSP by a portable dust meter are in accordance with the Manufacturer's Instruction Manual as follows:
  - Set POWER to "ON", push BATTERY button, make sure that the meter's indicator is in the range
    with a red line and allow the instrument to stand for about 3 minutes (Then, the air sampling inlet
    has been capped).
  - Push the knob at MEASURE position.
  - Push "O-ADJ" button. (Then meter's indication is 0).
  - Push the knob at SENSI ADJ position and set the meter's indication to S value described on the Test Report using the trimmer for SENSI ADJ.
  - Pull out the knob and return it to MEASURE position.
  - Push "START" button.

Maintenance and Calibration

- The 1-hour TSP dust meters are verified at 1-year intervals throughout all stages of the impact air quality monitoring.
- Calibration details for the dust meters are provided in Appendix E.

#### 24-hour TSP Monitoring

Installation

- 2.7 The HVSs were installed in the vicinity of the air sensitive receivers. The following criteria were considered in the installation of the HVSs:
  - A horizontal platform with appropriate support to secure the samplers against gusty wind was provided.
  - The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
  - A minimum of 2 meters separation from walls, parapets and penthouses was provided for rooftop sampler.
  - No furnace or incinerator flues were nearby.
  - Airflow around the sampler was unrestricted.
  - Permission was obtained to set up the sampler and to obtain access to the monitoring stations.
  - A secure supply of electricity was obtained to operate the sampler.

#### Preparation of Filter papers

- Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
- All filters were equilibrated in the conditioning environment for 24 hours before weighing. The
  conditioning environment temperature was around 25 °C and not variable by more than ±3 °C;
  the relative humidity (RH) was < 50% and not variable by more than ±5%. A convenient working
  RH was 40%.</li>
- ALS Technichem (HK) Pty Ltd. is a HOKLAS accredited laboratory which has comprehensive quality assurance and quality control programmes.

#### Monitoring Procedures

- The power supply was checked to ensure the HVSs work properly.
- The filter holder and the area surrounding the filter were cleaned.
- The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges.
- Then the shelter lid was closed and secured with the aluminum strip.
- The HVSs were warmed-up for about 5 minutes to establish run-temperature conditions.
- A new flowrate record sheet was set into the flow recorder.
- The flow rate of the HVS was checked and adjusted at around 1.1 m<sup>3</sup>/min. The range was between 0.6-1.7 m<sup>3</sup>/min.
- The programmable timer was set for a sampling period of 24 hrs ± 1 hr, and the starting time, weather condition and the filter number were recorded.
- The initial elapsed time was recorded.
- At the end of sampling, the sampled filter was removed carefully and folded in half length so that
  only surfaces with collected particulate matter were in contact.
- It was then be placed in a clean plastic envelope and sealed.
- All monitoring information was recorded on a standard data sheet.
- Filters were sent to ALS Technichem (HK) Pty Ltd. for analysis.

## Maintenance and Calibration

- The HVSs and their accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- HVSs are calibrated at bi-monthly intervals using GMW-25 Calibration Kit throughout all stages
  of the impact air quality monitoring.
- Calibration details for the HVSs are provided in Appendix E.

## Results and Observations

2.8 Dust monitoring was conducted for both 1-hour TSP and 24-hour TSP at all designated monitoring stations in the month. Air quality monitoring results and graphical presentations are provided in Appendix F.

## 1-hour TSP Monitoring

2.9 All measured 1-hour TSP levels complied with the Action and Limit Levels in the month. A summary of 1-hour TSP monitoring results is presented in Table 2.4.

Table 2.4 Summary of Impact 1-hour TSP Monitoring Results

Monitoring Station	1-hour TSP (μg/m³)	Action Level	Limit Level	No. of Exceedance	
ļ	Range	(μg/m³)	(μg/m³)	Action	Limit
ASR8	92.9 – 144.2	408.1	500.0	Nil	Nil
ASR17	95.2 – 136.7	408.4	500.0	Nil	Nil

#### 24-hour TSP Monitoring

2.10 All measured 24-hour TSP levels complied with the Action and Limit Levels in the month. A summary of 24-hour TSP monitoring results is presented in Table 2.5.

Table 2.5 Summary of Impact 24-hour TSP Monitoring Results

Monitoring Station	24-hour TSP (μg/m³)	Action Level	Limit Level		o. of edance
	Range	(μg/m³)	(μg/m³)	Action	Limit
ASR8	14.0 – 40.8	195.0	260.0	Nil	Nil
ASR17	18.5 – 38.9	174.1	260.0	Nil	Nil

#### NOISE

#### **Monitoring Requirements**

- 3.1 Noise levels at three designated monitoring stations were monitored in the month in accordance with the EM&A Manual. Appendix C shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The monitoring schedule for the month is shown in Appendix D. Noise monitoring stations are shown in Figure 3.1.

#### **Monitoring Equipment**

3.3 Integrating Sound Level Meter was employed for noise monitoring. They were Type 1 sound level meters capable of giving a continuous readout of the noise level readings including equivalent continuous sound pressure level (L<sub>eq</sub>) and percentile sound pressure level (L<sub>x</sub>). They comply with International Electrotechnical Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1). Portable electronic wind speed indicator capable of measuring wind speed in m/s was employed to check the wind speed. Table 3.1 details the noise monitoring equipment used.

Table 3.1 Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-18/31
Calibrator	Rion NC-73

#### Monitoring Parameters, Frequency and Duration

3.4 Table 3.2 summarised the monitoring parameters, period, frequency and duration of impact noise monitoring.

Table 3.2 Noise Monitoring Parameters, Frequency and Duration

Time Period	Parameters	Duration (min)	Frequency
Daytime (0700 to 1900 on normal weekdays)	L <sub>eq</sub>	30	Once per week

#### **Monitoring Locations**

3.5 In accordance with the EM&A Manual, three noise monitoring stations, as shown in Figure 3.1 were selected for noise monitoring. Table 3.3 describes the location of this monitoring station.

Table 3.3 Locations of Noise Monitoring Stations

Monitoring Station	Identity / Description	Level
SR3	International Christian Quality Music Secondary and Primary School	Roof top level of 7 storey building
SR4	Po Leung Kuk Grandmont Primary School	Roof top level of 7 storey building
SR6	Staff Quarter for Diamond Hill Crematorium	Roof top level of 1 storey building

## Monitoring Methodology

## Monitoring Procedures

- The Sound Level Meter was set on a tripod at a height of 1.2 m above the ground.
- Facade measurements were made at all three monitoring locations.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - frequency weighting: A
  - time weighting: Fast
  - time measurement: L<sub>eq</sub>(30 minutes) during non-restricted hours i.e. between 07:00 and 19:00 on normal weekdays
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- The wind speed was frequently checked with a portable wind meter.
- During the monitoring period, the L<sub>eq</sub>, L<sub>10</sub> and L<sub>90</sub> were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- Noise measurement was paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.

#### Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The meter and calibrator are sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- Calibration details for the sound level meter and calibrator are provided in Appendix E.

## **Results and Observations**

- 3.6 Noise monitoring was conducted at all designated monitoring stations as scheduled in the month. Noise monitoring results and graphical presentations are provided in Appendix G.
- 3.7 All measured noise levels complied with the Action and Limit Levels in the month. A summary of noise monitoring results is presented in Table 3.4.

Summary of Impact Noise Monitoring Results during 07:00 - 19:00 on Normal Table 3.4 Weekdays

Monitoring Station	Measured Noise Level, dB(A) L <sub>eg (30 min)</sub>	Calculated Construction Noise Level, dB(A)	Limit Level	No. Exceed	
	Average and Range	Average and Range		Action*	Limit
SR3	64.3 (63.7 – 65.0)	# (* - *)	70/65##	Nil	Nil
SR4	64.0 (62.6 – 65.0)	(# - #)	70/65##	Nil	Nil
SR6	62.6 (61.0 – 64.2)	(# - #)	75	Nil	Nil

<sup>\* -</sup> Action Level is triggered by receipt of a noise complaint

#### **ENVIRONMENTAL SITE INSPECTION** 4.

## Site Inspections

Site inspection was carried out on a weekly basis to monitor the timely implementation of proper 4.1 environmental pollution control and mitigation measures for the Project. In the month, five site inspections were carried out in the month. The summary of weekly environmental site inspections observations and environmental site inspection checklists are attached in Appendix H.

## Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team were inspected regularly. Observations 4.2 have been recorded for the monitoring works as follows:

#### Air Quality Monitoring

- The monitoring team recorded the observations around the monitoring stations within and outside of the construction site.
- The monitoring team recorded the temperature and general weather condition on the monitoring day.

#### Noise Monitoring

- The monitoring team recorded the observations around the monitoring stations, which might affect the results.
- Major noise sources were identified and recorded.

#### Advice on Waste Management Status

The actual quantities of inert C&D materials and non-inert C&D wastes generated by activities of the 4.3 Project in the month are provided in Table 4.1. Trip ticket system was implemented for all offsite waste disposal.

<sup># -</sup> Measured noise level is less than the baseline noise level
\*\*\* - reduce to 70dB(A) for schools and 65dB(A) during school examination periods

Table 4.1 Summary of Waste Disposal in the Month

Type of Waste	Material	Disposed Quantity	Destination
Inert C&D mater	ials	5 m³	Kai Tak Public Fill Barging Point
Non-inert C&D	Metals	Nil	Not Applicable
waste	Paper/cardboard packaging	Nil	Not Applicable
	Plastics	Nil	Not Applicable
	Chemical waste	Nil	Not Applicable
	Others, e.g. general refuse	21 m <sup>3</sup>	SENT Landfill

#### Status Environmental Licences and Permits

4.4 The status of all permits/licences obtained/in-use in the month is summarised in Appendix I.

#### Implementation Status of Environmental Mitigation Measures

- 4.5 An updated summary of the Environmental Mitigation Implementation Schedule (EMIS) is presented in Appendix J.
- 4.6 During the weekly site inspection conducted by the Environmental Team in the month, the following observations and recommendations were made.

#### Water Quality

The wheel washing facilities were not well maintained.

#### Air Quality

- Debagging/grout mixing was observed without enclosure. The Contractor was reminded to provide enclosed workshop for grout mixing activities to prevent emission of dust.
- Open grout mixing material bag was found without cover. The Contractor was reminded to provide cover or properly store the open grout mixing material.

## Noise

 No particular observations and recommendations were made during the weekly site inspections in the month.

#### Waste or Chemical Management

- Some water was stored in chemical waste storage area. The contractor was reminded to clean it as soon as possible.
- Stagnant water / water pondings was observed inside the site. The Contractor was reminded to remove the stagnant water or apply mosquitoes oil to prevent mosquitoes breeding.
- Broken sandbags were observed at site entrance and general refuse was observed scattered on site. The Contractor was reminded to improve housekeeping on site.
- Stockpiles of construction waste were observed on site. The Contractor was reminded to remove the construction waste regularly.

#### Landscape and Visual

 No particular observations and recommendations were made during the weekly site inspections in the month.

#### Others

 No particular observations and recommendations were made during the weekly site inspections in the month.

## Summary of Exceedances of Environmental Quality Performance Limit

- 4.7 The Event and Action Plans for air quality and noise are presented in Appendix K.
- 4.8 No exceedance of Action and Limit Levels for 1-hour and 24-hour TSP and noise was recorded in the month.

# Summary of Environmental Complaints, Notifications of Summons and Successful Prosecutions

4.9 Figure 4.1 presents the environmental complaint flow diagram of the Project and Table 4.2 presents the statistics of complaints, notification of summons and successful prosecution since the commencement of the Project.

Table 4.2

#### **Summary Of Environmental Complaints And Prosecutions**

Complain	ts logged	Summor	ns served	Successful	Prosecution
June 2006	Cumulative	June 2006	Cumulative	June 2006	Cumulative
0	0	0	0	0	0

4.10 No environmental complaint, notification of summons and prosecution was received or made against the Project in the month.

## 5. FUTURE KEY ISSUES

## Key Issues and Recommendations for Coming Month

- 5.1 Key issues to be considered in the coming month include:
  - Generation of dust from activities on-site;
  - Noise impact from operating equipment and machinery on-site;
  - Generation of site surface runoffs and wastewater from activities on-site;
  - · Storage and disposal of general refuse and construction waste from activities on-site; and
  - Management of chemicals and avoidance of oil spillage.
- 5.2 Recommendations for the coming month include:
  - Provide water spray to haul roads and unpaved areas;
  - Provide regular maintenance to wheel wash facilities on-site;
  - Cover the stockpiles on-site entirely;
  - Store all chemicals on site in the chemical storage area;
  - Ensure general refuse are sorted, recycled and disposed properly; and
  - Ensure construction waste are disposed off-site properly and regularly.

#### **Environmental Monitoring and Audit Schedule for the Coming Months**

5.3 The tentative schedules for environmental monitoring and audit for the next three months are provided in Appendix D.


#### 6. CONCLUSIONS AND RECOMMENDATIONS

#### Conclusions


6.1 Environmental monitoring and audit was performed in June 2006. All monitoring and audit results in the month were checked and reviewed.

	visioning of Diamond Hill Crematorium ly EM&A Report for June 2006 (Revision 0)					
6.2	All 1-hour and 24-hour TSP monitoring results Limit Levels.	s recorded in the month com	plied with the Action and			
6.3	All noise monitoring results recorded in the mon	nth complied with the Action	and Limit Levels.			
6.4	In general, the Contractor satisfactorily impler reasonably responsive to the ET's recomme weekly environmental site inspection.	In general, the Contractor satisfactorily implemented all the required mitigation measure and was reasonably responsive to the ET's recommendations on any discrepancy observed during the weekly environmental site inspection.				
6.5	No environmental complaint, notification summagainst this Project in the month.	nons or successful prosecuti	on was received or made			
	Recommendations					
6.6	According to results of weekly environmental construction programme for the coming month water quality and waste and chemical manager	n, recommendations for air q	uality, construction noise,			
P:\S079	904\REPORTS\Monthly\2006\0606\rev_0.doc 1	10	MAUNSELL AECOM			

**FIGURES** 

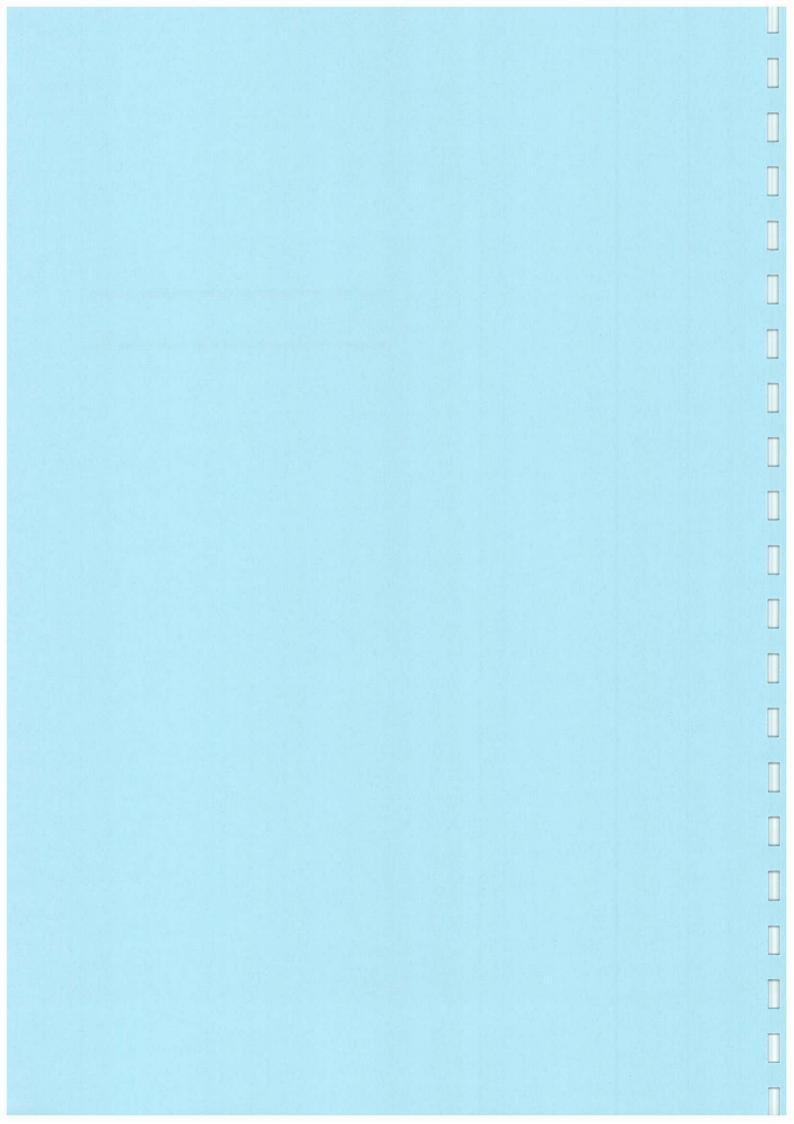

## PROJECT ORGANIZATION FOR ENVIRONMENTAL MANAGEMENT

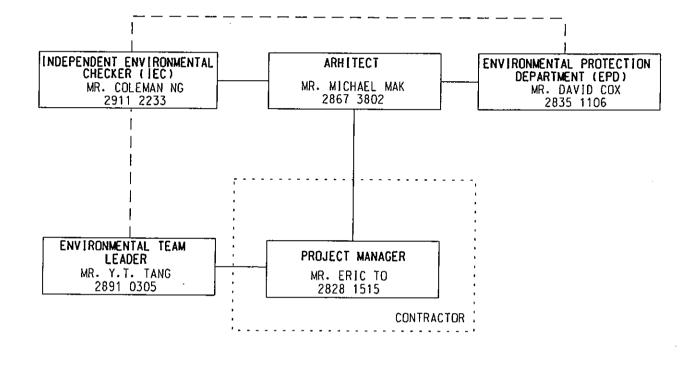

## LEGEND:

--- DIRECT COMMUNICATION

— — LIAISON

MAUNSELL AECOM


Maunsell Environmental

Management Consultants Ltd

CONTRACT NO: SS M333 - REPROVISIONING OF DIAMOND HILL CREMATORIUM

PROJECT ORGANIZATION FOR ENVIRONMENTAL MANAGEMENT

	SCALE	N.T.S.	DATE	200	5
i	CHECK	FSYY	DRAWN	LLM	IC .
	JOB No.		DRAWING	No.	REV
-		S07904		1.1	_

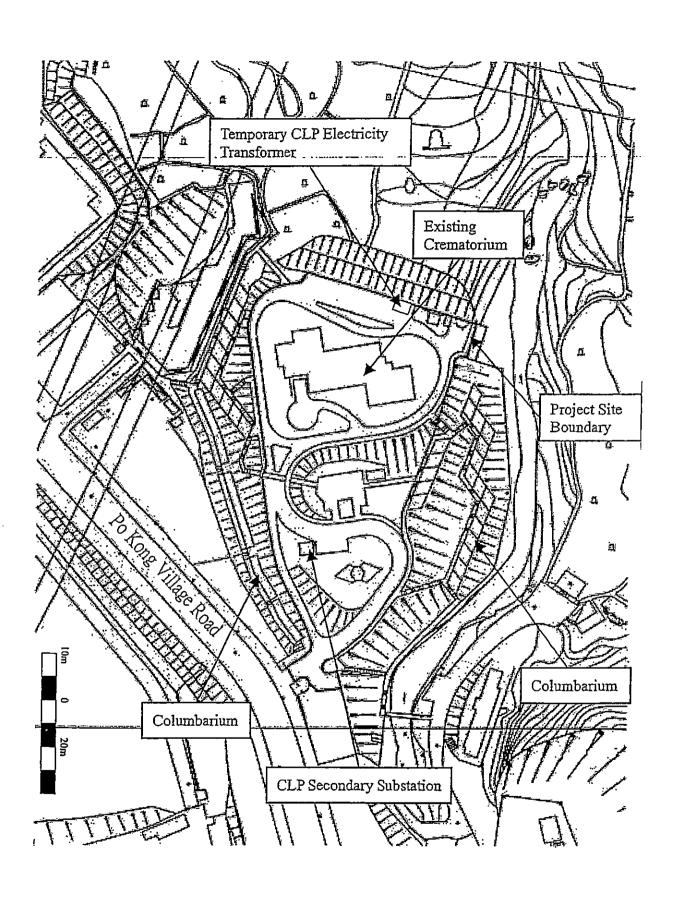



MAUNSELL AECOM


Maunsell Environmental Management Consultants Ltd CONTRACT NO: SS M333 - REPROVISIONING OF DIAMOND HILL CREMATORIUM

LAYOUT OF WORK SITE


SCALE	N.T.S.	DATE	200	5
CHECK	FSYY	DRAWN	LLM	IC
J08 No.	S07904	DRAWING	1.2	REV 

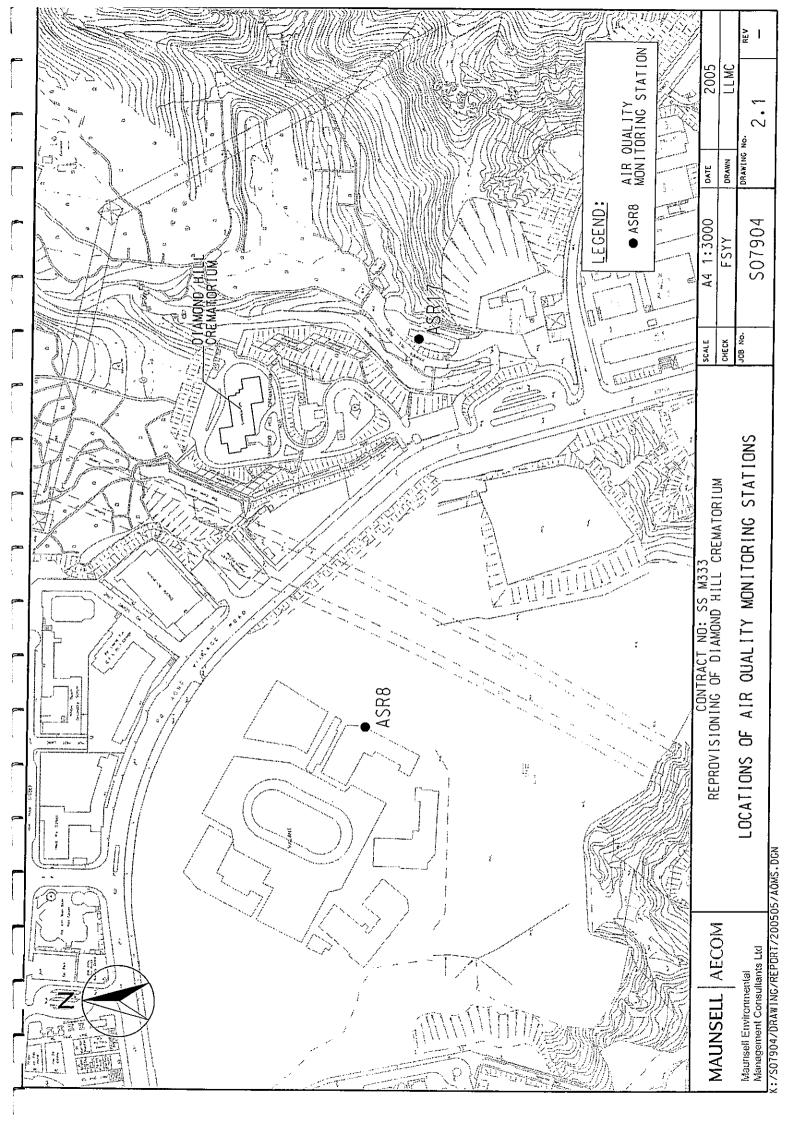

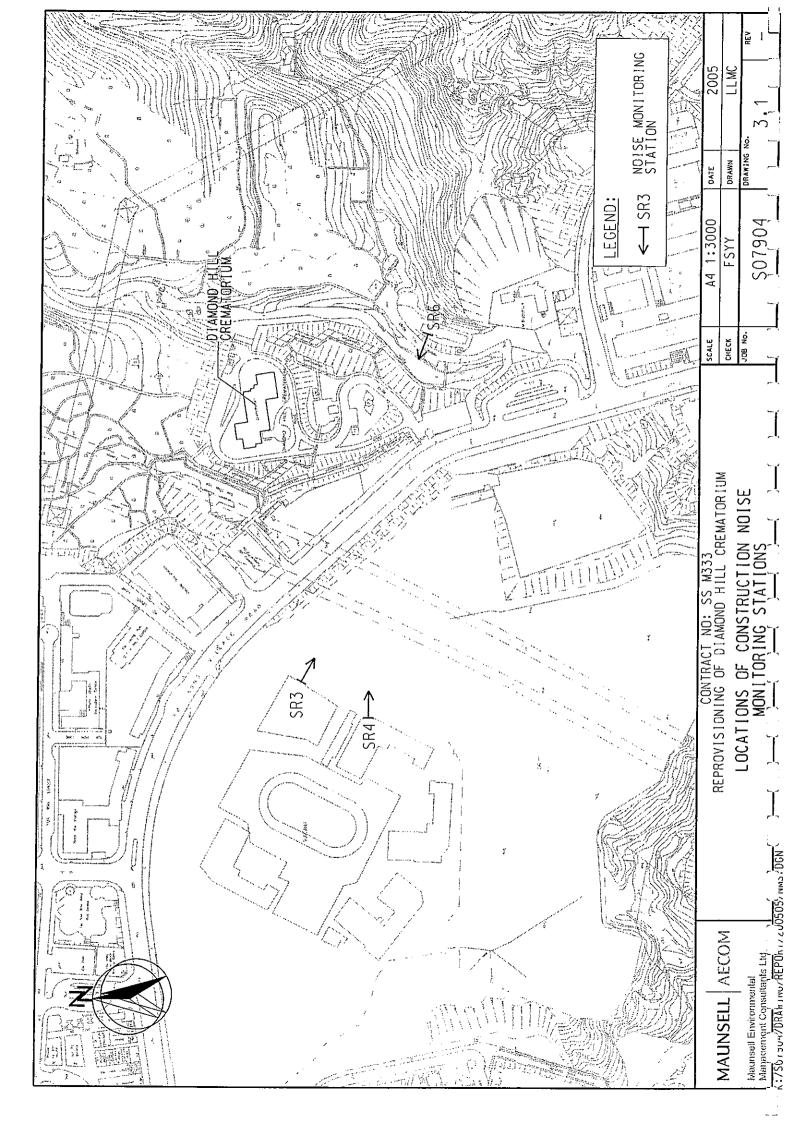

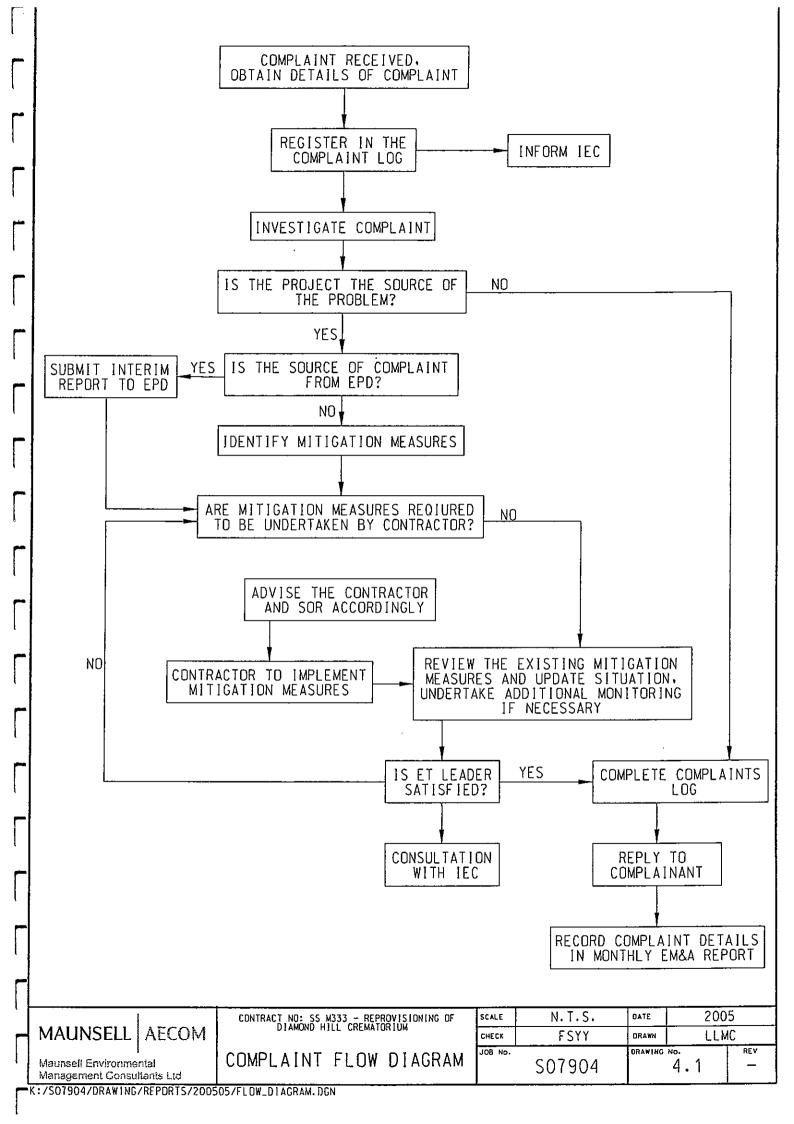


APPENDIX A
KEY CONTACTS OF ENVIRONMENTAL
PERSONNEL

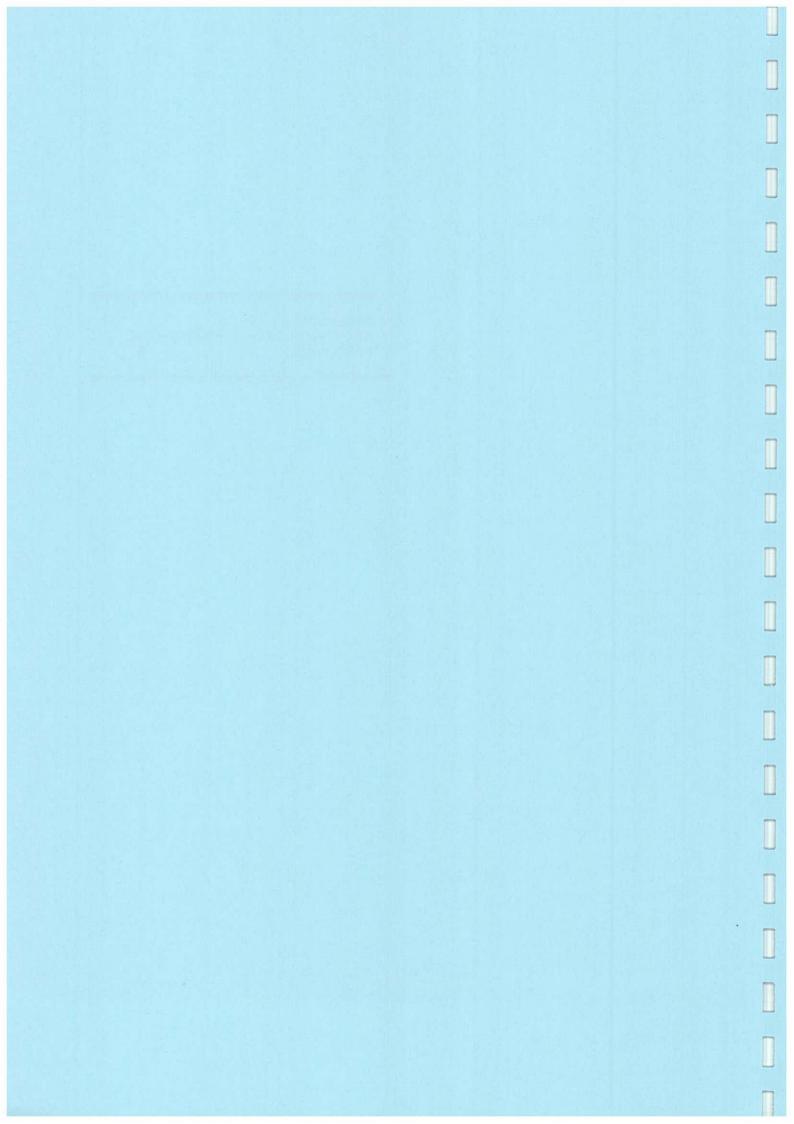


## Appendix A Key Contacts of Environmental Personnel

Party	Name	Telephone No.	Fax No.			
Environmental Protection Department						
SEPO	Mr. David Cox	2835 1106	2591 0558			
EPO	Ms. Marlene Ho	2835 1186	2591 0558			
EPO (ECD)	Mr. Charles Wu	2117 7540	2756 8588			
Architect						
Architectural Services Departn	nent					
Project Architect	Mr. Michael Mak	2867 3802	2524 8194			
Assistant Architect	Ms. Catty Chan	2867 3598	2524 8194			
Independent Environmental	Checker					
Hyder Consulting Limited						
IEC	Mr. Coleman Ng	2911 2233	2805 5028			
Assistant to IEC	Mr. Adi Lee	2911 2233	2805 5028			
Contractor						
China Resources Construction	Company Limited					
Project Manager	Mr. Eric To	2828 1515	2827 2921			
Environmental Team						
Maunsell Environmental Mana	igement Consultants Li	mited				
ET Leader	Mr. Y.T. Tang	2893 1551	2891 0305			
Audit Team Leader	Ms. Florence Yuen	2893 1551	2891 0305			
Monitoring Team Leader	Mr. Eddie Yang	2893 1551	2891 0305			


APPENDIX B CONSTRUCTION PROGRAMME

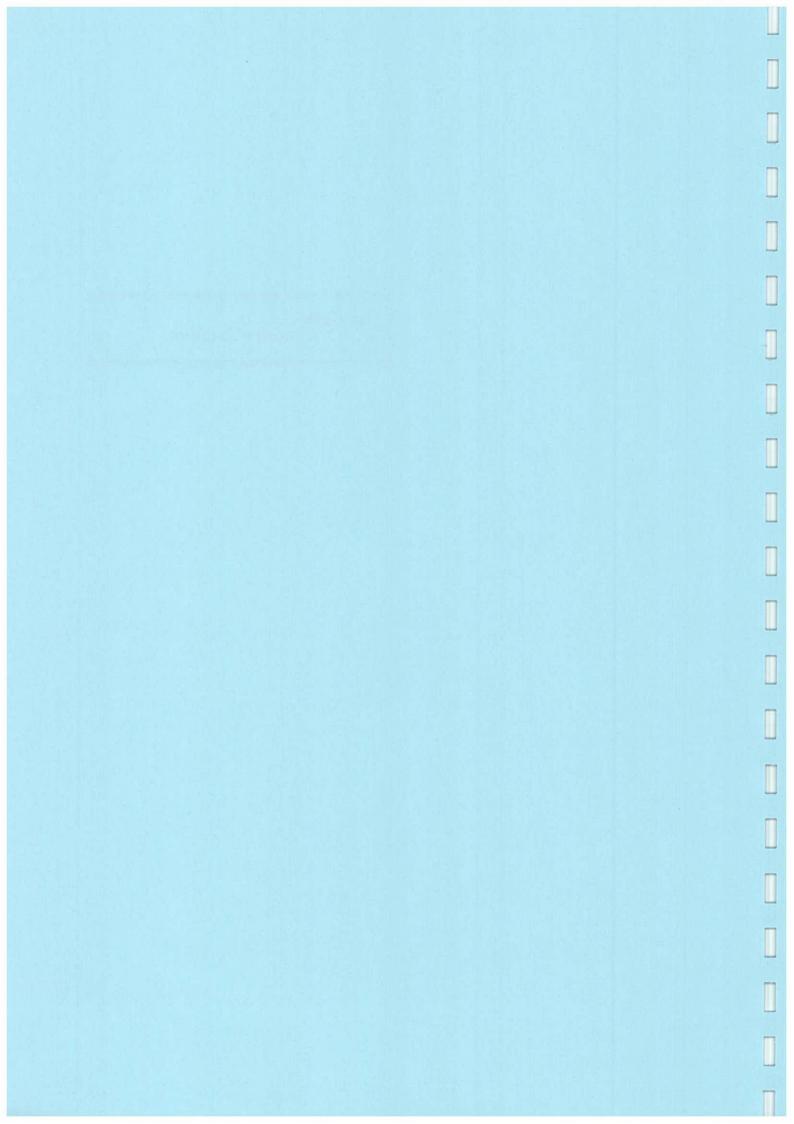



1   1   1   1   1   1   1   1   1   1	McMillian   McMi	
17-00   17-0	International Content	
Compared	Site Office Set Up   Tox Surery Served   Site Office Set Up   Tox Surery Served   Submit West Hampenan Mark   Submit West Hampenan Mark   Submit West Hampenan Mark   Submit West Hampenan Mark   Assemble Wall   Fowling Encline   Assemble Wall   Fowling Encline   Assemble Wall   Fowling Encline   Settline (Street Mark   Submit West Mark   Settline (Street Mark   Street Mark   Settline (Street Mark   Street Mark	
1   1   1   1   1   1   1   1   1   1	Stile Office Sci Up   150 Office Sci Up   15	1   1   1   1   1   1   1   1   1   1
Compared	Tine Suring Region   Tine Su	1   1   1   1   1   1   1   1   1   1
1   1   1   1   1   1   1   1   1   1	Submit West Manyecont Nat.   1 day   5 (11) 200   1	1   1   1   1   1   1   1   1   1   1
1.   1.   1.   1.   1.   1.   1.   1.	Foreign   Fore	COLD
Column	Howfling Exertion	
Column   C	Area B (Type 2)	C   C   C   C   C   C   C   C   C   C
State   Stat	Section   15 per 21   23 dept   23 dept   23 dept   24	12   四 - e+p   2xx
Characteristics   Line   Lin	Actuary 14.75   A.21     Actuary 14.75   A.21     Actuary 14.75   A.21     Actuary 1.15   A.21     A.21   A.21     A.22   A.21     A.22   A.21     A.23   A.21     A.24   A.21     A.25   A.25     A.25   A.25     A.25   A.25     A.25   A.25     A.25   A.25     A	2302   10   10   10   10   10   10   10
The property   The	Savijen   Okeraning Styre   1   35 days   21107/05   231073337   CSD for Well Unit to Drive Inc.   10 days   11   120	(4) (4) (4) (4) (4) (4) (4) (4) (4) (4)
Comparison   Com	CSD for BCG Billites Diversive   Rel. days   11/11/2004   27/20/2005   Reliad UG-1/40/20 Birchings from ASD   Relias   16/1-40/30   14/20/3005   14/20/3005   14/20/3005   14/20/3005   14/20/3005   14/20/3005   14/20/2005   1	(4)   (4)
Comparison   Com	Revised UC; PACD Ensemble Community   Revised UC; PACD Ensemble Community	COLD (1995年   177   COLD (1995年   178   COLD (1995 
Comparison of the properties	Revised UACIFS Pressed Direction ASD   20 degree   100 Table   1	ACTOR STATES 170  200 SECTION 170  200 S
Comparison of the comparison	Revined Active Revined Library   1822/2023   1917/2024   1822/2023   1917/2024   1822/2023   1917/2024   1822/2023   1917/2024   1922/2023   1917/2024   1922/20	4   180-185-18-18-18-18-18-18-18-18-18-18-18-18-18-
State		100   100
1	Instruction	STATE
1	Approved of Incomming Childs Duste JOs Rencing by CLP   1 dry   2017/2021	10072 210 31 4-2 210 31 4-2 210 31 1-2 110 11 11 11 11 11 11 11 11 11 11 11 11
1 Apr	Submission of CAD (Arbitezensy)   1 day 7.112/2634     Submission of CAD (Genul)   1 day 7.112/2634     Arbitezial of CAD   1 day 7.12/2434     Read Diversion is U.G. UZiliza Divasion   0 days 28/11/25/20     Area A. Hermer-Hird (Doctocal)   0 days 28/11/25/20     Area A. Hermer-Hird (Doctocal)   0 days 28/11/25/20     Area C. Hermer-Hird (Doctocal)   0 days 28/	717 3.145 217 3.175 217 3.175 218 1.15 218 1.15
Company   Comp	Approxic CSD (Finit)   15 days   211/2006     Approxic CSD   1 day   220/2006     Ave. A. Harmar Hind (Debecar)   0 days   291/0000     Ave. A. Harmar Hin	210   220
Discouration   1 July   2 Ju	Approval of CSD	2027 2027 2027 2027 2027 2027 2027 2027
Columbia	0 days 29/16/200 0 days 29/16/200 0 days 29/16/200	2. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1.
The control of the	0 days 20100000	
1	Usass Ziffuzon Usass Ziffuzon	
Color   Colo	Units 271100XO4	
1   1   1   1   1   1   1   1   1   1		71 7101
1980   1980	1802001 2810200   0.0452   28102003	7 7 7 1
1	Sie Channe	7,01
1	Release Far Birk (FBD)	<del></del>
1 Any   1 An	The state of the s	<del>76.</del> 1
1-44   187-1201   18	2 days 17/12/2001	<del>. 7.</del> T
Prince   P	14th Real Parity 1812/2001	<del></del>
Present   Pres	Beering Emise	
11   12   13   14   14   15   15   15   15   15   15	Brak Ue Eristine Payment	
11   12   13   13   13   13   13   13	The Wisher War and The Wisher Washington	
Colored   Colo	10 days 11/1/2015	1111 13 km
Second   S	SOUTH RESERVE PLANT STATE OF THE	10000
Parental	KI Jans 6/12/2/014	
19-days   24/12000   21/1200   21/	Danklin Failus & Return	
Marchel   15 April	100700 O Cont.	Ľ
15 kg   17 mark	19 4845 30/12/2001	Ĭ
1	DIEST, UP ESTRING PAYERES! 15 days 24/12/2001	-
Principal Control Co	Drawin & Cole Drds	
Street   S	Backfilling & Turnic (Arm C) & C2)	100
1   1   1   1   1   1   1   1   1   1	HEAVY	25 M 27
1   1   1   1   1   1   1   1   1   1	W. Car 31/12/201	
18 degree   18 degree   20172003   20172004   20172005   2017200	Seese Up till Bood Paris	
E-Footing         Refined         17/10/2010         2017/2010 <th< td=""><td>Demolish Elle Tunet &amp; Backell</td><td></td></th<>	Demolish Elle Tunet & Backell	
Action   A	Custors less Reference	
Contract Rev Visitory Claim Walls   State Chance   13 days   51 days   51 days   15 days   16	\$ 1877.UC	N/2 [1] 2522
15 days   16 d	State of the state	
Very ( dan WALE)   14 Apr.   17 DOM	According Carth Park Station Changed	
	Conduct New Well-way (fem Webs)	Ž.
State   Stat	Greaters & 127105 Section Communication	
Studies   Stud	Children Nicelle	
State   Stat	LAZEN FILE CLINTIS SALVENS	
State   Stat	Brimps First Murtals : SS days 21 (1) (1)	
Sec   State	Walneying (F.3.)	
1 day   2727501   2457505   172750	STATE OF THE PROPERTY OF THE P	
A CALC Dark   1 day   1702005   1702005   1 day   1702005   1 day   1702005   1 day   1702005	STAIRS CONTROL CONTROL STAIRS STAIRS	
1   1   1   1   1   1   1   1   1   1	Remove of Dark Pa & Oble Deci	
1   1   1   1   1   1   1   1   1   1	Calif. Lying by C19	
15   15   15   15   15   15   15   15	Cally Termination in Steam's Boson	
Chick   Chick of School   Ch	2000	
Compared   1 day   1	13 dey (72.00 Clb): 25 dey (72.00 Clb):	
	Set Up Traffic Coulted Point for Section 1	77
ing December 7 is Reverate Natural States 1 Jays 15th 2010th 2010	Total Control of the	
ESS	- AND THE COMME	
En [T. Torestal and to 19.99 The Landscheek [ZZZZZZ] substitute shallen.	MAILAL RE TABLE	F32    E12
ten the state of t		
	E55 12.00 12.00 12.00 12.00	LENGERGER ZZZZZ FURBILITY FIRESTRY
ANTHER CONTRACTOR OF THE PROPERTY FRANCES FRAN	#####################################	(Tenerate C) agent
	Wavesty :	Dimmillal Cramboling at N. Ere, (Whee Best E. E. Lea Good Com-

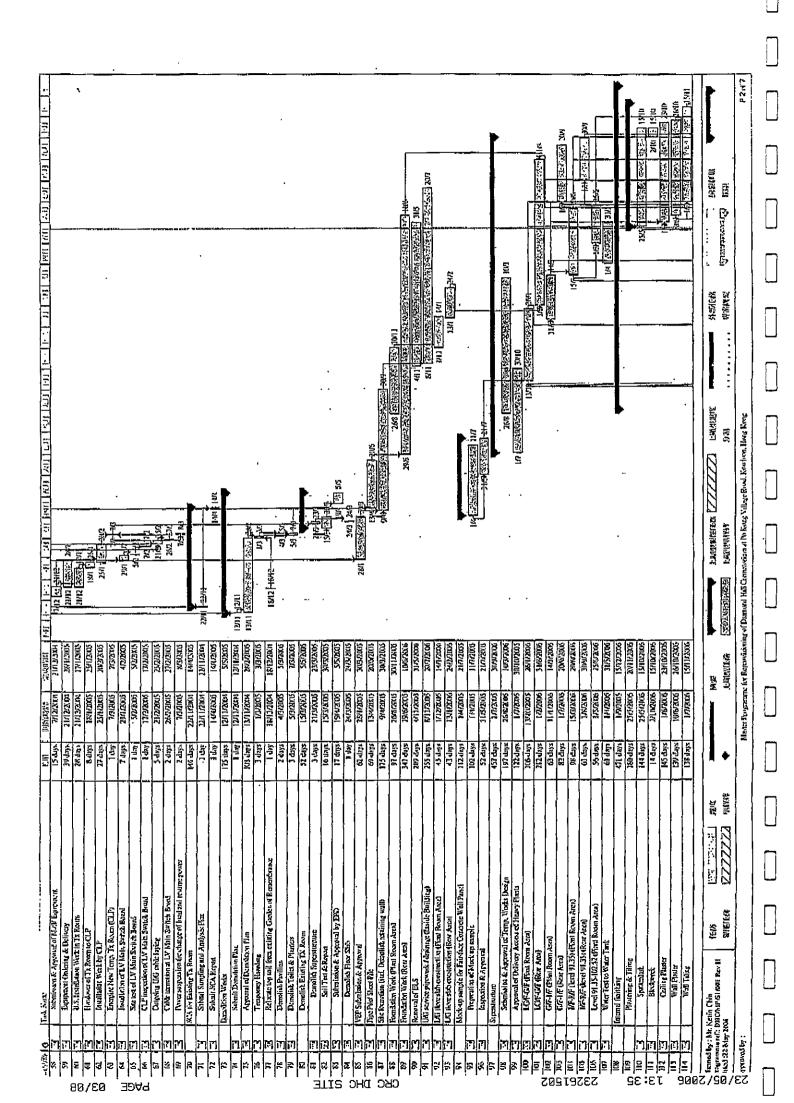

116 2   Proceeding   117   Proceeding   118 2   Proceeding   118 2   Proceding & Proceding   118 2   Proceding   119 2   Proceeding   119 2   Proceding   119 2   Proceding   119 2   Proceeding   119 2   Proceding   119 2   P		Sign.	24.30							A 12 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
ישומים א								<del></del>		101 (20 ) 1 (2
វិ		Soulms	THEY	2011/306					-	Π
ר מי מי מי מי		277 days	377,506	STEEL STREET						
חרות	52	7 क्रांक	TENZALIA	AUTON					. /	1000
		11.6	Stunger	Analta fant				-	7	2
		***	The same	This Hard				•		
		25 UR53	W.HUAICA	APLITATES						TOTAL STATE
1	א אמבקונסה לגינונגני	45 days	1713/2506	IST 27200 }					•	
7]	300	36 days	INTERPORTE	50067511753						
 [1]		11453	IKTIZIKE	23/11/20CK					_	
1M i Sie & Medect.		Se dans	SPACE S	AMERICAN				7		\$
ľ				AND INCOME.					1.1.	
,1	Personal Approximate	Z/J flags	LAWREDS	31,5720.			S:	118 国际 医安里特氏病	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	
_	Settoil & Asymen of Fabrical to Proposite	106 dzys	CELLE	30777406					がおきた	
<u> </u>	miraling & fashChing Procedure	137 dgss	SUPPOR	316/2TE					The state of the s	
		117. June	AMUDI	2 distance				=	TOTAL PARTY OF THE	
		ctom cto	CANTAIN TO A	Dille Dag						WE 528
+		s(ma)	CV ICO	12/10/2000						d.
٦	-	इत्या ह	23/10/2008	2002/11/01		•				Law Biggins
7	Shop Dearing Schmission and Apparent of Rolly Shutter	243 days	DECEMBE!	3115/2006				100mmの対象を対象を対象を対象を対象を対象を対象を対象を対象を対象を対象を対象を対象を対	The second section of the second section of	
_	GLT	e day:	1AVXON:	TOW, XILES				-		
	Missellaneard	P(D-dr-late)	Supple.	27/11/11/12				_	_	
								-	10 CONT. 151 PK	\$. \$4
	ideat	1 th u 2 th	DOM/DIC	10/10/3KS	•				•	ľ
71			SURSECTION OF THE PERSON	25/8/200			•		-	THE PERSON NAMED IN COLUMN NAM
	Full	11 Cars	15/10/2006	25/(02/06)						<u> </u>
131 III	legald	71 Jan	MARKETER	KOLUTERA						
Į.								<del>_</del> ;		
1		Triple.	ilitirecto.	3011/3020			•	-	<del>,</del>	HANTE SEE THE
2		10 195	III SZECK	304771302						
		2 sys	SILZZOX	ICH 37XC6		•				
		F. Jahr	ATTACK IS	in Color	•					
			Christia	- Action						-
I		1/3/01/25	COMPAN	MEGAM			•		•	12年 1887年 18874 18875 18875 18875 18875 18875 18875 18875 18875 18875 18875 1
		413 Cays	ZNWZIED	10772Tal	•			. 5		
3	appoint Windows	433 days	254474103	33710/2016						
Ŧ	lesange & Apresal	*(fr) 13/2	23,800,003	31/5/2006			Z,	TAN BESTER AND STREET OF THE PARTY OF THE PA	South Carlo	The state of the s
	INCOV	Midde	SONOS	TUNISHIK						
<u></u>	9	1/Qalance	9413021	MATCHIST						am G
		efde in	Name of the last	76			ur			一 できる がない 一 ことの
		N mays	CHANTANET	SILISO WIN					-	SAM 3100
1		172-1135	1772005	3357306						「京 世天 は不 できる」
η		46 chys	SH222KH	15/2/2006				-		100
	d Fixing)	· 22 days	POSTOS	3023/2006						
-		1	Selection.	2,103,210,44						AND THE PROPERTY OF
î		74 06.73	11 MARKET	251112003	•	•				
7		क्ष्म १९	CO.C.S.				•			Cut Child Edward
		462 days	26/K/X/05	SOCIESTIS.						
1	Spirit & Approval	274 4175	26/2/2005	115200			F. Hole	Transfer of the Party of	CHEST PART HANN STATES	A Land
ग	UpSimple	122 days	1/3/2006	TUNKADE					٠.	
	raceas	TANK	ANG DI	MACE!	•				The Property of the Control of the C	
$\overline{}$		tion at	COO7rial	San Carro	•					_
1	very	20rp (9	577/2006	1597506						中國民主要 2
= 1		61 क्षेत्रक	HIDWAR	3317 [72005]			•		_	
AS .		472 days	36/6/3/05	1017/1015			<u>.,,</u>			38
-	Men & Aremai	274 days	2678/2005	315/5/05			, L'S	7	Ţ	
Color Carrier of Mark Bassand	Sympe	135,6	ATTACA DE	TOWNER				Property of the Control of the Contr	i.	:
	and an artist of	e Com yy	LATERIA	7000					4年次 34年後	2000 PM
		(ip)	L742IXK	00005					<u> </u>	The Park
	ivery	S(c) 19	1577.3706	1559,000			•		-	100 PM
57		64 days	MINORIKE	ACCULTURE.	•				_	
1			1111000	10000					•	TOPOLOGICAL STATE OF THE STATE
+		- Control	insarai	WILL LAND					_	
	q	Madus	Traces	XVIII:DXX						
Aleb Drawing Submission & Appental	wice & Appenial	1224153	374/2005	31/2/2005					[2] [14] [14] [14]	1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
7	Jy Sample	LS days	1452206	1SVBZZXK						100
Title Contraction of Agreement	Liveral	16.bts	1620106	31KG'RS				·- <u>-</u>		
The Manufacture & Dallyn	ALL	2 1/2 Lan	AMMAN	a teleprone						-
				1						F K WASSILSONIAN
wood by a Ma. Kerner Chain	Man Territoria and			Į.		- Buchena P7777	Name of the least		The state of the s	1 to see that the second secon
	(4,4,4,4,4)		<u>.</u> .	14 14 14 14 14 14 14 14 14 14 14 14 14 1	<b>•</b>	1.60以来使性的 [2222]				
	WENTER CALLLA UNI	Na Area	_			北松型相談等	<b>777</b>		Company Company	- 421 DIG!
unthu.										

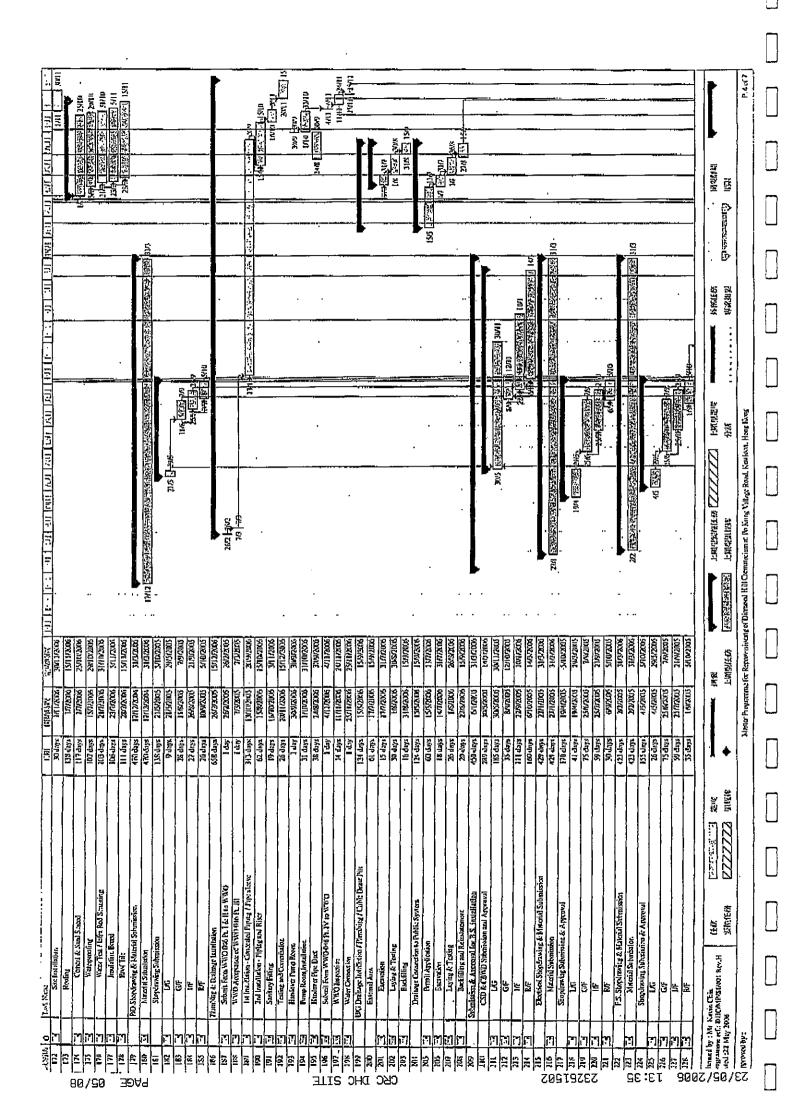

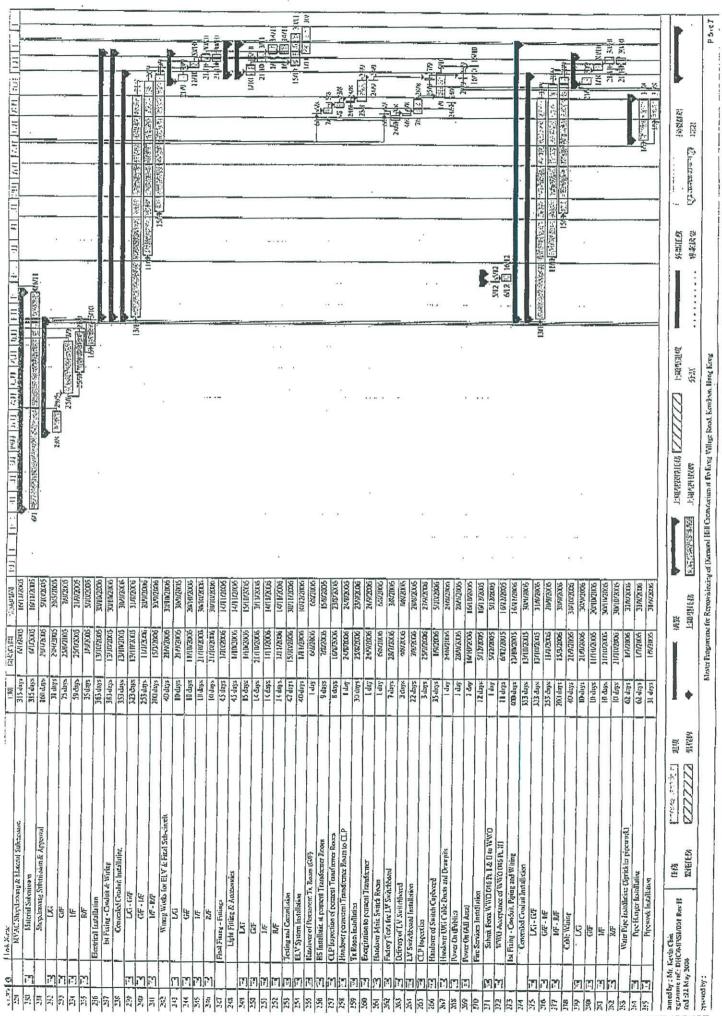


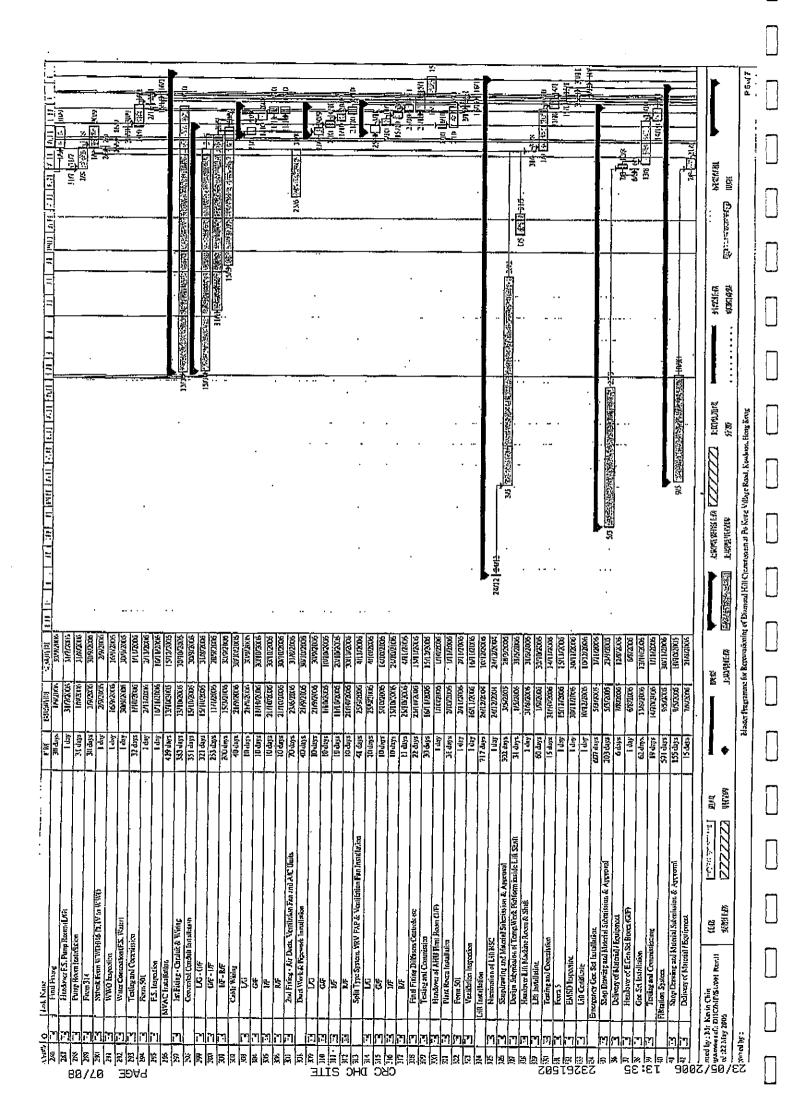

. 1	Rady	i	TAN ALZE	1				_	
	presilizaci inch	1	DAMPING	15000304				•	是一一
11.4 Li Tivari tal Civarimos vanc	!	4	In Kuzhen	EU BLICH		•			1001
2		- 1	ANI SEZIKH	TYEZCNIK	Þ				-  -
- 1	Mark Dataing & Equipment Sixuaising and approxim	273455	2KT 22X101	23500316	Ed Ilva	计数据处理 不是 医阿克克斯氏 计可以存在 化聚合物			
1	or Erning of Sechard, made Chinney	র্থকুত	1/11/2/19	31/1 3/X05			事 · 一 · · · · · · · · · · · · · · · · ·		-
1		म्योग्राम्	SUSTORIOR	1755/35ki				7777718	
$\exists$		10° 430°	100,000	TRUDESTRE					アノノバミー
$\overline{}$	he Hilligs .	skipzy	BINICEDIKIE FEDICESTIKIE	15.12.12 KK				es es	
		Kap   1	BUKENE.	15/1 37,30.8s.				oko o v	3
Γ		() (J. 15)	16/11/2/06	Same				•—	
354 1 Bridger of THE Rock		197	16/11/2006	ILVI RYCH					
1		11.1	12/11/19/05	Seri Single				**************************************	
		- 11 June	A DIVINE	Twen William			_	**	Such III
147 FULL FULL		efun race	The Land of the Land	Superior S			_		
i		SUP-PUS	JILEGER D	SHAWALD.			_		
3.3%   Brandin for Falling		१५१ कुरू	24 I PS 106	10023036			First .	CONTRACTOR OF THE TOP	
		102 (27)	37/J306	STATE				95] [15] 中国的位置《英国特别》	-
		110 days	1355KK	KINDEK.			-		
		45 dzys	1,62,005	1300306				16.3	
		- Colored	14 TUSIY IK	11 GAVING				ea:	2 2
		c(rp.o.	וני וכויים	Christia					ા માર્ચ ાજા
		31 طولت	WAND.	31.823.15					7 (2) (3) (4) (4)
		전하기	10/8/01	JOSE STATES					VIII - 1
L		101 days	PAIRE	TRUBUS				2.300.000.000.000.000.000.000.000.000.00	
_		Midan	1Srsokin	MARKE				,	
-		11,100	1 ROOM	TANCOUR.					
Out to District		10.1	TO THE PARTY OF	Tanamar,					
1		1700	La SCA OI	CALL TO BE					
+		1040	DAG TES	XIIIZIKE					I I I I I I I I I I I I I I I I I I I
Contract Part		46 देव ५३	1630,310%	KVEI PAKE					
7		t divis	16 P. NO.	54 202 (15					
_	person & Approved	100 TU	175XD6	310/02/08				01	
		31 days	94222/11/17	31/10/X OV					
_		30 days	SYXXII IN	SYLVACTK				<del>,</del>	_
Removal of Staffseling		31 das	MENTANE	MARKE				<del>V 147</del>	
-		Same	SANCTOR	SHEDICK.				•	
		of the second	THE PARKET	Children of				•	
-   -		SET TO	1000	IN LEGAND				dhon	
1		44 mm 1	TO SERVE	2000					
1		chinc	Day County	C. 1707.17					100 Tel 100
+		Odeys	N.V.T.Y.O.	287,9706					302 1
$\frac{1}{1}$		Odlys	42112006	4711/106					•
		- Hays	11/11/21/06	S31721172					
_		र्यका	25111500	27117866					
		Ciday	15/11/2/06	15/11/2/106				- sit	
ENSO irrection		UNATE	10V 173006	3071372.06				404	
		Odzys	17/2/2006	TOTANOOR				•••	
Shint & Approval of Final GBP		31 days	PERIOR	31.652.006				-	
-		Ti Cars	ANICH!	TO.W.DEB					<u>.</u> [
Nufuii Formatti		(1 dias	MITTER	ALIGNES A					
+		1	1At 17X F.C.	SALIN IN					
+		Tue -	1011/01/11	CONTRACTOR				<b>15.22</b>	II. A. A. IVAI
+		ಬಾಗಿ 1	11,2350	11 23.00				_	
S Hinkwer of Section 1		l day	NIZXE	1812/206	ļ				
-									
STATE OF STATE AND STATE OF ST			 	1882 1241/1863	SALAN SALAS	Handeline [ZZZZZ] Hanner Handiner	· 公司(5)	Characteristic Mai	BASSON.

Z3/02/Z002 I3:32 Z3ZEI20Z

APPENDIX C ENVIRONMENTAL ACTION AND LIMIT LEVELS

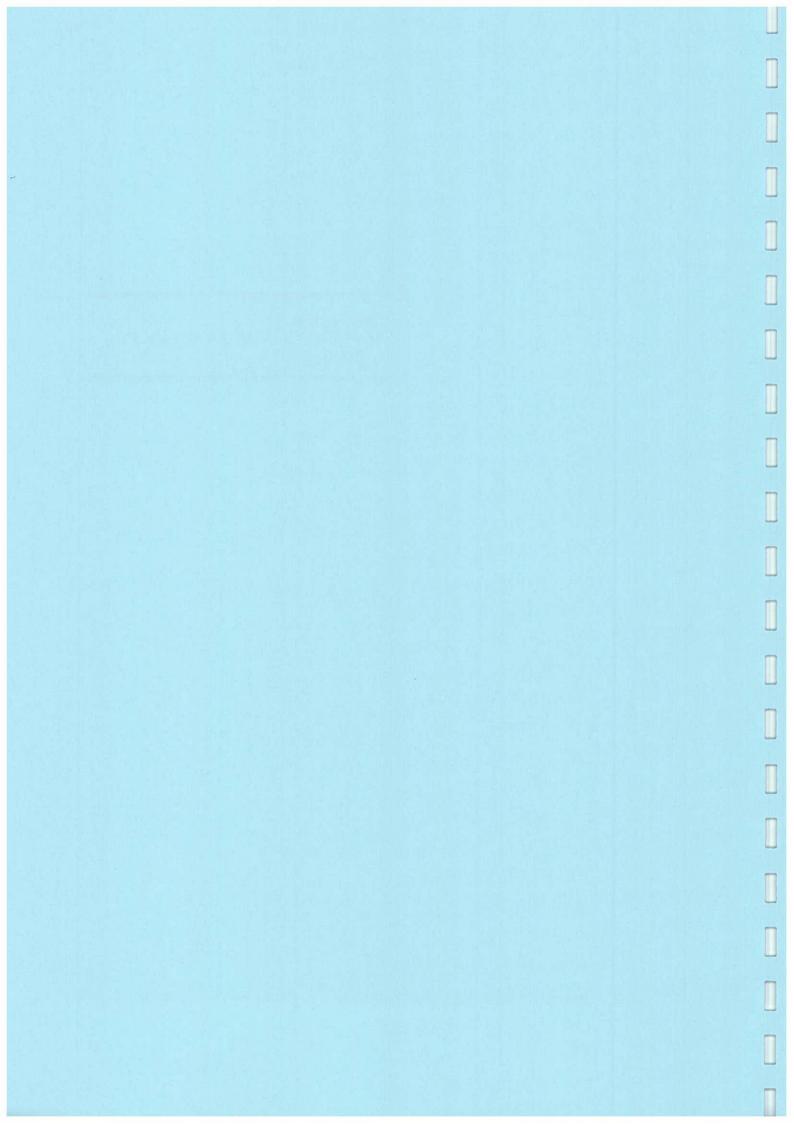

#### Appendix C Environmental Action and Limit Levels

#### Action and Limit Levels for 24-hour TSP

Monitoring Station	Action Level (μg/m³)	Limit Level (μg/m³)
ASR8	195.0	260
ASR17	174.1	260

#### Action and Limit Levels for 1-hour TSP

Monitoring Station	Action Level (μg/m³)	Limit Level (μg/m³)
ASR8	408.1	500
ASR17	408.4	500


#### Action and Limit Levels ( $L_{\text{eq}}$ ) for Construction Noise

Time Period	Action Level	Limit Le	vel	
		SR3	SR4	SR6
0700 – 1900 hours on normal weekdays	When one documented complaint is received	70/65*	70/65*	75
0700 - 2300 hours on public holidays including Sundays and	from any one of the sensitive receivers	stipulate	to requirem d in future	
1900 - 2300 hours on all days		Construc	ction Noise	Permits
2300 - 0700 on all days				

<sup>\*</sup>reduce to 70dB(A) for schools and 65dB(A) during school examination periods

•	

APPENDIX D ENVIRONMENTAL MONITORING AND AUDIT SCHEDULES

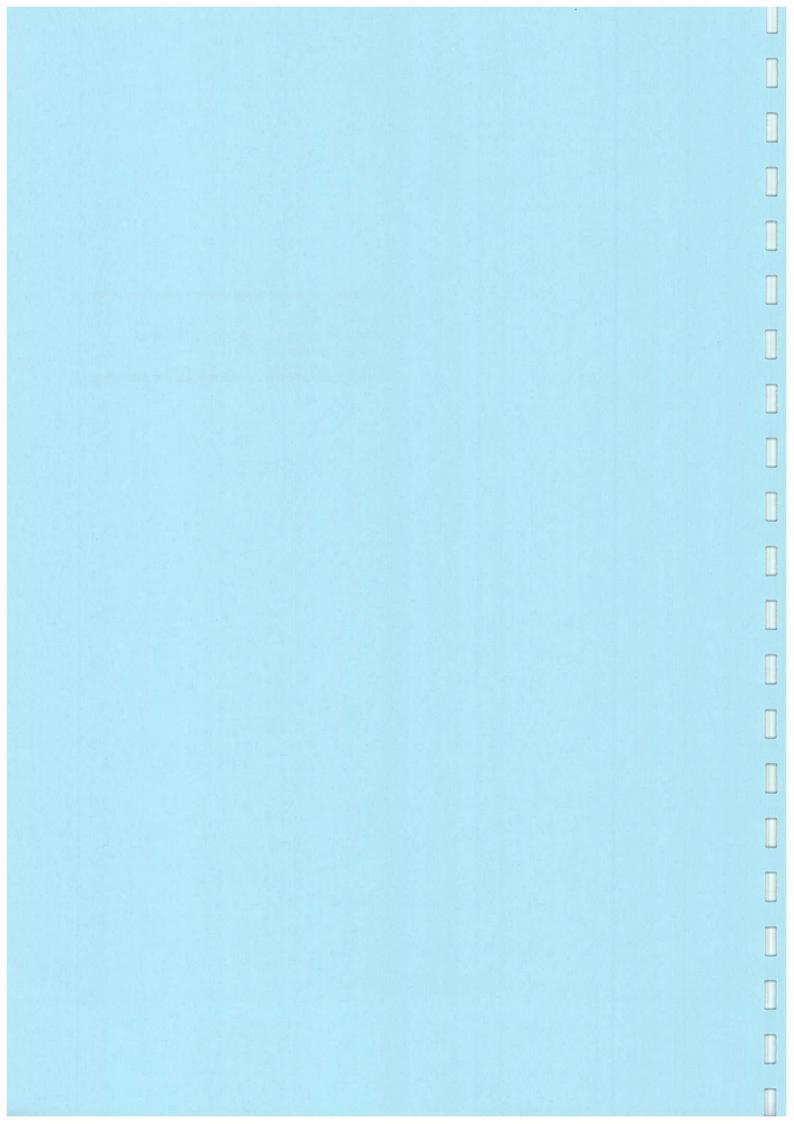

Reprovisioning of Diamond Hill Crematorium Impact Air Quality and Noise Monitoring and Audit Schedule for June 2006

Saturday 3-Jun	뜻	Noise	10-Jun	Q	0000	17-Jun			24-Jun				-		
Friday 2-Jun	24-hour TSP		unr-6	1-hour TSP		16-Jun			23-Jun			30-Jun	24-hour TSP		
Thursday 1-Jun		Site Environmental Audit	mnC-8	24-hour TSP		15-Jun	1-hour TSP Noise		22-Jun			29-Jun			
Wednesday			7-Jun		100 A 10400 00000 0000 0000	ote Etivitolitierital Addit	24-hour TS	Site Environmental Audit	21-Jun	1-hour TSP Noise		28-Jun			(adverse weather, etc)
Tuesday			e-Jun			13.18			20-Jun	24-hour TSP		27-Jun	1-hour TSP Noise		
Monday See See		• **	5-fun			40		,	19-Jun	in.	Site Environmental Audit	26-Jun	24-hour TSP	Site Environmental Audit	o change due to unforese
Some Sunday Seed			A- 1:0	7					18-Jun			25-Jun			The schedule is subject to change due to unforeseeable circumstances

Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for July 2006 Reprovisioning of Diamond Hill Crematorium

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

Reprovisioning of Diamond Hill Crematorium Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for August 2006

Monday
1-hour TSP Noise
08-Aug
15-Aug
22-Aug
28-Aug 29-Aug
24-hour TSP


The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc)

Tentative Impact Air Quality and Noise Monitoring and Audit Schedule for September 2006 Reprovisioning of Diamond Hill Crematorium

06-Sep 07-Sep
12.Con
24-hour TSP
20-Sep 21-Sep
24-hour TSP 1-hour TSP Noise
27-Sep 28-Sep
24-hour TSP 1-hour TSP Noise

The schedule is subject to change due to unforeseeable circumstances (adverse weather, etc.)

APPENDIX E CALIBRATION DETAILS

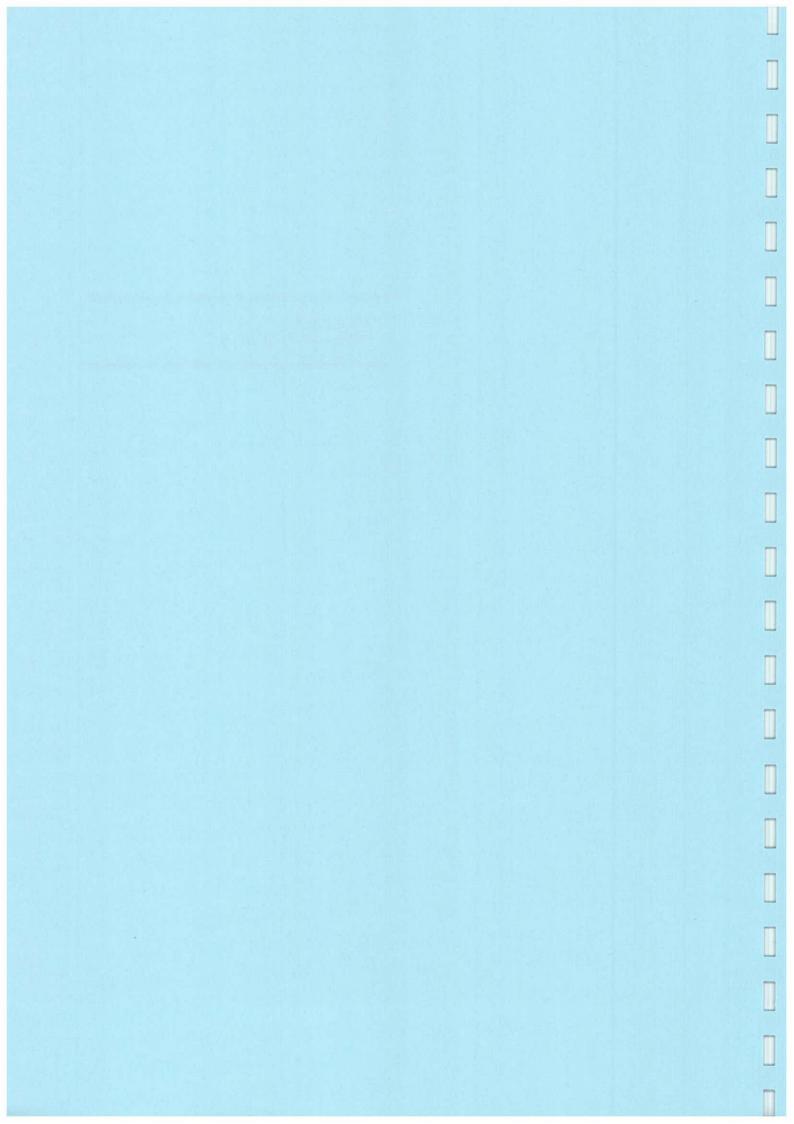

Station	Po Leung Kuk G	irandmont Primar	y School (ASR8)	Operator:	Porky	y Chu	_
Cal. Date:	03-Jun-06			Next Due Date:	03-A	ug-06	
Equipment No.:	A-001-69T			Serial No.	07	16	-
	<u>-</u>	<del></del> -	Ambient	Condition		<del></del> -	***
	T ((4)	001	·			758.5	
Temperatu	re, Ia (K)	301	Pressure, F	ra (mmng)		130.0	
<del>.</del> .		<del></del>	Orifice Transfer S	tandard Informatio	n		
Seria	l No:	988	Slope, mc	2.00878		ept, bc	0.00015
Last Calibra	ation Date:	15-Nov-05		mc x Qstd + bc	= [DH x (Pa/760) x	(298/Ta)] <sup>1/2</sup>	
Next Calibr	ation Date:	15-Nov-06			Pa/760) x (298/Ta)]		
	<del></del>	<u>.                                      </u>			<u>.</u>		· · · · · · · · · · · · · · · · · · ·
<u></u>	······································		<del></del>	f TSP Sampler	t n e	0 Fl Bd.»	
			Orfice		HV	S Flow Recorder	
Resistance Plate No.	DH (orifice), in. of water	[DH x (Pa/7	60) x (298/Ta)] <sup>1/2</sup>	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Reading IC (CF	
18	14.0		3.72	1.85	53.0	52.68	
13	12.5		3.51	1.75	50.0	49.70	)
10	9.0		2.98	1.48	40.0	39.76	j
7	7.5		2.72	1.36	36.0	35.78	1
5	3.0		1.72	0.86	21.0	20.87	
By Linear Regre Slope, mw = Correlation Coe *If Correlation Co	32.2457 fficient* =	_	<b>9973</b> brate.	Intercept, bw =	-7.3	8013	-
			Set Point	Calculation	<u></u>	<u> </u>	
From the TSP Fi	eld Calibration C	urve, take Qstd =				······································	·
		ne "Y" value accor					
		mu	y Ostd + hw = IC	x [(Pa/760) x (298/	Га)] <sup>1/2</sup>		
		****	A GOIG ! DII - IV	, ((	,,		
Therefore, Set P	oint; IC = ( mw x	Qstd + bw ) x [( 7	'60 / Pa ) x ( Ta / 29	98 )] <sup>1/2</sup> =		34.83	_
<u> </u>							
Remarks:				<del> </del>	<u> </u>		
		- <del></del>		C . A . C	<u>.                                    </u>	1 ,	n A-a 1
QC Reviewer:	Eddie Jan	my _	Signature:	(dol)		Date:	

P:\General\HVS\S07904\ASR8\2006\ASR8\_60603.xls

Station	Po Leung Kuk 0	arandmont Prima	ry School (ASR8)	Operator:	Pork	y Chu	
Cal. Date:	06-Apr-06			Next Due Date:	06مل	un-06 .	
Equipment No.:	A-001-69T	•		Serial No.	07	716	
		•			-		
			Amblent	Condition			
Temperatu	ure, Ta (K)	297	Pressure, I	Pa (mmHg)		761.9	
	· · · · · · · · ·			tandard Informatio	··· ··· ···	<del> </del>	
	l No:	988	Slope, mc	2.00878		ept, bc	0.00015
Last Calibr		15-Nov-05			= [DH x (Pa/760) x		
Next Calibr	ation Date:	15-Nov-06		$Qstd = \{[DH \times ($	Pa/760) x (298/Ta)]	"" -bc} / mc	
<u> </u>	1			f TSP Sampler	,	S Flow Recorder	
Resistance Plate		<del>(</del>	Orfice				
No.	DH (orifice), in. of water	[DH x (Pa/7	(60) x (298/Ta)] <sup>1/2</sup>	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Reading IC (CFM	
18	13.7		3.71	1.85	53.0	53.16	
13	12.4		3.53	1.76	49.0	49.14	
10	8.7		2.96	1,47	41.0	41.12	
7	7.3		271	1.35	36.0	36.11	
5	3.1		1.77	0:88	22,0	22:06	
By Linear Regre Slope , mw = Correlation Coe	ession of Y on X 31.7179 efficient* =		9977	Intercept, bw =	-6.0	1309	
*If Correlation Co	pefficient < 0.990	, check and recal	brate.	_			
			Set Point	Calculation			
From the TSP Fi	eld Calibration Co	urve, take Qstd =	1.30m³/min				
		e "Y" value accor					
		mw	$x Qstd + bw = 10^{\circ}$	x [(Pa/760) x (298/1	[a)] <sup>1/2</sup>		
		<b></b>		a v1/2		AP 4A	
Therefore, Set Po	oint; IC = ( mw x	Qstd + bw ) x [( 7	60/Pa)x(Ta/29	g )]=		35.10	
			· · · · · · · · · · · · · · · · · · ·				
Remarks:							
i ioiiidilya,			<u></u>				
				2100	<del></del>		
QC Reviewer:	Eddie H	mg	Signature:	dol)		Date: 14 · 4 ·	2006
	<del>( )</del>	1			· · · · · · · · ·		
P:\Genera	INHVS\S07904	NASR8\2006V	SR8_60406.xls				

Station	Staff Quarter For	Diamond Hill Cr	ematorium (ASR17	) Operator:	Porky	/ Chu	
Cal. Date:	03-Jun-06	_		Next Due Date:	03-Aı	ug-06	
Equipment No.:	A-001-21T			Serial No.	102	278	-
		• • · ·	Ambient	Condition		<u> </u>	
Temperatu	ıre, Ta (K)	301	Pressure, f	Pa (mmHg)		758.5	
		<u>,                                    </u>					
			Orifice Transfer S	tandard Informatio	on		
Seria	l No:	988	Slope, mc	2.00878		ept, bc	0.0001
Last Calibra	ation Date:	15-Nov-05			= [DH x (Pa/760) x		
Next Calibra	ation Date:	15-Nov-06		Qstd = {[DH x (	Pa/760) x (298/Ta)]	<sup>1/2</sup> -bc} / mc	
		•					
		·	Calibration o	f TSP Sampler			
		(	Orfice		HV:	S Flow Recorder	
Resistance Plate No.	DH (orifice), in. of water	[DH x (Pa/7	(60) x (298/Ta)] <sup>1/2</sup>	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flov Reading IC (CFI	
18	13.0		3.58	1.78	49.0	48.71	
13	12.0	<del></del>	3.44	1.71	46.0	45.72	1
10	9.0		2.98	1.48	41.0	40.75	1
7	8.0	-	2.81	1.40	38.0	37.77	
5	3.5		1.86	0.93	26.0	25.84	-
By Linear Regre Slope , mw =	ession of Y on X 26.1140			Intercept, bw =	1.5	935	
Correlation Coe	fficient* =	 0.	9969				
'If Correlation Co	- pefficient < 0.990,	check and recal	brate.	_			
		"	Set Point	Calculation			
From the TSP Fig	eld Calibration Cu	rve, take Qstd =	1.30m³/min	·	•		
From the Regres	sion Equation, the	e "Y" value accoi	ding to				
		mw	$\mathbf{x} \cdot \mathbf{Qstd} + \mathbf{bw} = \mathbf{IC}$	x [(Pa/760) x (298/	Га)] <sup>1/2</sup>		
				- 1 <b>-1</b> /2		05.70	
Therefore, Set Po	oint; $IC = (mw x C)$	Qstd + bw ) x [( 7	60 / Pa) x (Ta / 29	98 )]" <sup>-</sup> =		35.76	-
			<u> </u>			<del></del> -	<del></del>
Remarks:							
Hemarks:							
			<u> </u>				,
	Eddie	Janz,	Cimnot	1 de g		Date: 6 · 6 · 2	006
QC Reviewer:	(0000)	1-1	Signature:	<del>~~ /                                  </del>		Dale	
P:\Genera	11/HVS\S07904	∖ASR17\2006	\ASR17_60603.	xls			

Station	Staff Quarter Fo	r Diamond Hill Ci	rematorium (ASR17	) Operator:	Pork	y Chu
Cal. Date:	06-Apr-06	•		Next Due Date:	J-30	un-06
Equipment No.:	A-001-21T			Serial No.	102	278
	<del></del>	•				
			Ambient	Condition		
Temperatu	ıre, Ta (K)	297	Pressure, i	Pa (mmHg)		761.9
-		_ · · · · · · · · · · · · · · · · · · ·		tandard Informatio		
Seria		988	Slope, mc	2.00878		ept, bc 0.00015
Last Calibra		15-Nov-05			= [DH x (Pa/760) x	
Next Calibr	ation Date:	15-Nov-06		Qstd = {[DH x ()	Pa/760) x (298/Ta)]	"~ -bc} / mc
		•	0-1:5	ATOD Complex	,	· · · · · · · · · · · · · · · · · · ·
	1		<del></del>	f TSP Sampler	LINE	S Flow Recorder
Resistance Plate		1	Orfice	1		
No.	DH (orifice), in. of water	.   [DH x (Pa/7	60) x (298/Ta)] <sup>1/2</sup>	Qstd (m³/min) X - axis	Flow Recorder Reading (CFM)	Continuous Flow Recorder Reading IC (CFM) Y-axis
18	12.8		3.59	1.79	48.0	48.14
13	11.7		3.43	1.71	46.0	46.13
10	9.2		3.04	1.51	40.0	40.12
7	7.8		2.80	1.39	37.0	37.11
- 5	3.6		1.90	0:95	25:0	25.07
Slope , mw = Correlation Coe	27.5671  fficient* =  pefficient < 0.990,		9991 . brate.	Intercept, bw = _	-1.2	073
			Cot Point	Calculation		
From the TSD Sie	eld Calibration Cu	ının take Oetd		Valuation		
	sion Equation, the					
nic 1 (pg/c)	orest references, as		9 10			
		mw	x Qstd + bw = 1C :	x [(Pa/760) x (298/1	[a)] <sup>1/2</sup>	
Therefore, Set Po	oint; IC = ( mw x (	Qstd + bw ) x [( 7	60/Pa)x(Ta/29	B )] <sup>1/2</sup> =		34.53
						·
		· · · · · · ·				
D '						
Remarks:			···		<del></del>	
					<del> </del>	
	Eddie Ja	in I	O'	Sdor		Date: 14.4 2006
QC Reviewer:	( ) - ( ) ·	<del>'</del>	Signature:		······	Date:
P:\Genera	V !\HV\$\\$07904	NASR17\2006\	ASR17 60406.	xls		

#### EQUIPMENT CALIBRATION RECORD

Type:					Laser Du	ıst Moni	tor		
	acturer/Brand:			-	SIBATA				
Model					LD-3				
	ment No.:				A.005.07	2			
	ivity Adjustment	Scala Sa	ttina:		557 CPA				
Sensi	Ivity Adjustinent	OCAIG OC	ung.		007 CF7				
Opera	tor:				Eddie Ya	ng (EWN	(Y)		
Standa	rd Equipment								
Eguipr	ment:	Rui	opred	cht & Pai	ashnick	TEOM®			
Venue					ing Seco		chool)		
Model	-			400AB					
Serial			ntrol:		AB21989	9803			<del></del>
Ocual	110.		nsor:	-	0C14365		K <sub>o</sub> : 12500		
Last C	Calibration Date*:			2006	0014000	73000	16, 12000		
*Remar	ks: Recommend	ed interva	al for	hardwar	e calibrat	ion is 1 y	/ear		
Calibra	tion Result								
Soneit	ivity Adjustment	Scola Sa	ttina	(Refore	Calibratio	ເກໂຕ	<i>557</i> CF	M	
	ivity Adjustment						557 CF		
Sensit	ivity Adjustment	Scale Se	ung	(Altel C	alloradon,	١.	<u> </u>	141	
Hour	Date	•	Time	<del></del>	Amt	ient	Concentration 1	Total	Count/
1	(dd-mm-yy)				Cond		(mg/m³)	Count <sup>2</sup>	Minute <sup>3</sup>
	(42 ),,				Temp	R.H.	Y-axis		X-axis
					(°C)	(%)			
1	18-06-06	09:00		10:00	28.9	82	0.02370	768	12.80
2	18-06-06	10:00		11:00	29.1	82	0.02161	707	11.78
3	18-06-06	12:00		13:00	29.5	82	0.02609	822	13.70
4	18-06-06	13:00	<del></del> -	14:00	29.6	81	0.01991	603	10.05
							shnick TEOM®	1 000	, ,,,,,,
Note:	2. Total Count	was loga	od by	d seer I	Just Mon	ni ox i-ale itor	STITICK TEOM		
	3. Count/minut	GDOI COM	eu by Iculai	y Lascii fed by (T	otal Com	nt/60)			
	S. Countrillian	.c was ca	icaia:	rea by (1	Otes COU	1400)			
By Line:	ar Regression of	YorX							
	(K-factor):	1 01 7	0	.0019					
	ation coefficient:			.9281					
Validit	y of Calibration F	Record:		8 June 2	007	· <del>-</del>			
Remark									
Kemark	.5.								
									.
1				•					]
		· · · · · · · · · · · · · · · · · · ·				/	$\sim$		
				_,		9 dd//	1 )		- 0000
QC Re	eviewer. <i>Eddie</i>	e Yang		Signa	ture: _	1 ~ 1/	Date	∍: <u>19 Jur</u>	ne 2006

#### **EQUIPMENT CALIBRATION RECORD**

Type:				Laser Du	st Monit	or		
	acturer/Brand:		1-61	SIBATA		management, and a state of the		
Model			_445	LD-3				
	nent No.:			A.005.07				
Sensiti	vity Adjustment S	Scale Setting	);	557 CPM				
Operat	lor:			Eddie Yar	g (EWN	<u>(Y)</u>		
Standar	rd Equipment				And the Control of th			
Equipn	nedi:	Runnre	echt & Pat	lashnick T	EOM*			
Venue		Cyherr	ort (Pui Y	'ina Secol	ndary Sc	hool)		
Model			1400A8					
Serial I		Contro		AB21989	9803			
COLIER I		Senso		0C14365		K <sub>o</sub> : 12500		
Last C	alibration Date*:	-	e 2005		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	Manager and the second	*	Arrana
'Remark	ks: Recommende	ed interval fo	r hardwar	e calibrat	ion is 1 y	/ear		
	tion Result					, agy s <sub>ar</sub> san rayon ya maka danaman makabababa dana sadan sanaman da sada sada sada sada sada sada sada		····
	manuscript of the engineering and the engineering of the engineering o							
Sensiti	ivity Adjustment	Scale Setting	g (Before	Calibratio	n):	557 CP		
Sensiti	ivily Adjustment	Scale Setting	g (After Ca	elibration)	:	557 CP	M	
,		es. 100 102 2 100 100 100 100 100 100 100 1		<del>,</del>			Tatel	Count
Hour	Date	Tim	е	Amb		Concentration	Total	Minute <sup>3</sup>
	(dd-mm-yy)			Cond		(mg/m³)	Count <sup>2</sup>	X-axis
<b>t</b>				Temp	R.H.	Y-axis		V-axi2
ļ	10.00	45-53		(°C)	(%)	0.02866	731	12.18
1	19-06-05	10:00 -	11:00	29.3	81		731	12.02
2	19-06-05	11:00 -	12:00	29.3	<u>80</u>	0.02849	<del>*</del>	- <del>-</del>
3	19-06-05	12:00 -	13:00	29.4	80	0.02709	695	11.58
4	19-06-05	15:00 -		28.9	82	0.02740	707	11.78
Note:	2, Total Count 3. Count/minut	was logged e was calcul	by Laser (	Dust Moni	ilor	ishnick TEOM <sup>®</sup>		
	ar Regression of		0.0000					
	(K-factor):		0.0023	, .,. ,				
Correi	ation coefficient:		0.9169					
Validit	y of Calibration F	Record:	19 June 2	2006	Harry CD VI He			
<b>D</b>								
Remark	(§.							
								supermunitation.
				,				
!		<del>namangan ayan</del> aka dipa ga il 6 kishina 144			SAN	2	19	16/200
QC R	eviewer: <i>Eddie</i>	Yang .	Signa	iture:	( [ [	/ Dale	e:	
					W.	J		

#### **EQUIPMENT CALIBRATION RECORD**

	acturer/Brand:		3	aser Du SIBATA D-1	st Monit	or			
Model	No.: nent No.:			1.005.05a	<u> </u>				
	vity Adjustment S	Scale Setting:		510 CPN					
Operat	or:		<u></u>	Eddle Yaı	ig (EWN	Y)			
Standar	d Equipment								
Equipn	nent:	Ruppre	cht & Pat	ashnick T	EOM"	. Y		<del></del>	
Venue	;		ort (Pui Y	ing Seco	ndary So	hool)	4-10AEAT77~		· ·
Model	No.:	Series			······································				
Serial	No:	Control		AB21989					
		Sensor		OC14365	9803	K <sub>o</sub> : 12	2500		
Last C	alibration Date*:	_18 June	≥ 2005						a , - qui promi
'Remarl	ks: Recommende	ed interval for	hardwar	e calibrat	ion is 1 y	rear			
Calibrat	tion Result	Speed to 2.4 ms have been desprised age							
Sensili	vity Adjustment S	Scale Setting	(Before	Calibratio	n):	510	_ CPI		
Sensit	ivily Adjustment !	Scale Setting	(Alter Ca	alibration)	) <b>:</b>	510	_ CPt	ΛÍ	
Hour	Date	Time	· ·	Amt		Concentration	on	Total	Count
j	(dd-mm-yy)			Cond		(mg/m³)		Count <sup>2</sup>	Minute
	!			Temp	R.H.	Y-axis			X-axis
				(°C)	(%)	0.04009		2087	34.78
11	09-07-05	10:00 -	11:00	27.3	90_	0.04908 0.03566		1711	28,52
2	09-07-05	14:00 -	15:00	28.6	85 84	0.03059		1495	24.92
3	09-07-05	15:00 -	16:00	28.2 28.3	84	0.03033		1189	19.82
4 Note:	09-07-05   1. Monitoring d	16:00 -	17:00					,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	,,
Slope	2. Total Count 3. Count/minut ar Regression of (K-factor): ation coefficient:	was logged be was calculary or X	oy Laser (	Dust Mon	itor				
Validit	y of Calibration F	Record:	9 July 200	06					
Damad	<b>75</b> .								
Remark	. <del></del>		18 V - 1 V -						
Ĺ									
it i									
L									.,
					911	2		91-	7/2005
ወር ይ	eviewer: Eddie	e Yang	Signa	ture:	1 W /		Date	a:/	72000
CIO IN	EVIEWEI. LOGIC	2 1 277189	0.5,		<del>\( \)</del>			The strategy are	



#### SOILS & MATERIALS ENGINEERING CO., LTD.

G/F., 9/F., 12/F., 13/F. B. 20/F., Leadur Centre. 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. 行形设行近过37赋判这中心地下、9被·12根·13似及20框 E-mail: smec@clgisnec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533

#### CERTIFICATE OF CALIBRATION

Item tested   Page   1   of   2	
Description: Sound Level Meter (Class I) , Microphone Preamp Manufacturer: Rion, Co., Ltd. , Rion, Co., Ltd. NH-21 Type/Model No.: 00320528 , 102439 , 03575 Adaptors used:	
Manufacturer: Rion, Co., Ltd. Rion, Co. Ltd. Rion, Co. Ltd. Rion, Co. Ltd. Rion, Co. Ltd. Type/Model No.: NL-31 . UC-53A NH-21	
Client: Maunsell Environmental Management Consultants Ltd. Request No.: Date of request: 25-May-2006  Date of test: 26-May-2006  Reference equipment used in the calibration  Description: Model: Serial No. Expiry Date: Traceable to: Multi function sound calibrator B&K 4226 2288444 11-Jan-2007 CIGISMEC Macauring amplifier B&K 2610 2346941 30-Nov-2006 SCM Signal generator DS 360 33873 30-Nov-2006 SCM Signal generator DS 360 61227 06-Jun-2006 NIM	-
Client: Maunsell Environmental Management Consultants Ltd. Request No.: Date of request: 25-May-2006  Date of test: 26-May-2006  Reference equipment used in the calibration  Description: Model: Serial No. Expiry Date: Traceable to: Multi function sound calibrator B&K 4226 2288444 11-Jan-2007 CIGISMEC Macauring amplifier B&K 2610 2346941 30-Nov-2006 SCM Signal generator DS 360 33873 30-Nov-2006 SCM Signal generator DS 360 61227 06-Jun-2006 NIM	_
Request No.: Date of request: 25-May-2006  Date of test: 26-May-2006  Reference equipment used in the calibration  Description: Model: Serial No. Expiry Date: Traceable to: Multi function sound calibrator B&K 4226 2288444 11-Jan-2007 CIGISMEC Moscuring amplifier B&K 2610 2346941 30-Nov-2006 SCM Signal generator DS 360 33873 30-Nov-2006 SCM Signal generator DS 360 61227 06-Jun-2006 NIM	-
Date of test: 26-May-2006  Reference equipment used in the calibration  Description: Model: Serial No, Expiry Date: Traceable to: Multi function sound calibrator B&K 4226 2288444 11-Jan-2007 CIGISMEC Measuring amplifier B&K 42610 2346941 30-Nov-2006 SCM Signal generator DS 360 33873 30-Nov-2006 SCM Signal generator DS 360 61227 06-Jun-2006 NIM	<b></b>
Date of test:         26-May-2006           Reference equipment used in the calibration           Description:         Model:         Serial No.         Expiry Date:         Traceable to:           Multi function sound calibrator         B&K 4226         2288444         11-Jan-2007         CIGISMEC           Model:         2346941         30-Nov-2005         SCM           Signal generator         DS 360         33873         30-Nov-2006         SCM           Signal generator         DS 360         61227         06-Jun-2006         NIM	-
Reference equipment used in the calibration  Description: Model: Serial No. Expiry Date: Traceable to: Multi function sound calibrator B&K 4226 2288444 11-Jan-2007 CIGISMEC  Measuring amplifier B&K 2610 2346941 30-Nov-2006 SCM Signal generator DS 360 33873 30-Nov-2006 SCM Signal generator DS 360 61227 06-Jun-2006 NIM	
Description:         Model:         Serial No.         Expiry Date:         Traceable to:           Multi function sound calibrator         B&K 4226         2288444         11-Jan-2007         CIGISMEC           Measuring amplifier         B&K 2610         2346941         30-Nov-2006         SCM           Signal generator         DS 360         33873         30-Nov-2006         SCM           Signal generator         DS 360         61227         06-Jun-2006         NIM	
Multi function sound calibrator         B&K 4226         2288444         11-Jan-2007         CIGISMEC           Moasuring amplifier         B&K 2610         2346941         30-Nov-2005         SCM           Signal generator         DS 360         33873         30-Nov-2006         SCM           Signal generator         DS 360         61227         06-Jun-2006         NIM	
Milaight annuala	
Temperature: (22 ± 1) °C  Relative humidity: (65 ± 10) %  Air pressure: (1000 ± 10) hPa	
Test specifications	
The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580; Part 1: 1 and the lab calibration procedure SMTP004-CA-152.  The electrical tests were performed using an electrical signal substituted for the microphone which was removed at replaced by an equivalent capacitance within a tolerance of ±20%.  The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the did between the free-field and pressure responsess of the Sound Level Meter.	nd
Cest results	
This is to certify that the Sound Level Meter conforms to B\$ 7580: Part 1: 1997 for the conditions under which the test vas performed.	
Details of the performed measurements are presented on page 2 of this certificate.	
Actual Measurement data are documented on worksheet	
Approved Signatory: Date: 26-May-2006 Company Chop: 原文試验 Signatory: Date: 26-May-2006 Company Chop: 原始 Signatory Chop: 原始 Sign	
comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and arry no implication regarding the long-term stability of the instrument.	
Solis & Materials Engineering Co., Ltd. Form No.CARP162-1/Issue 1/Rev.8/01/05/20	XO.5

Hong Kong Accreditation Service (HKAS) has accredited this laboratory under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS Directory of Accredited Laboratories. The results shown in this certificate were determined by this laboratory in accordance with its terms of accreditation. Such terms of accreditation stipulate that the results shall be transable to the International System of Units (5.1.) or recognised measurement standards. This certificate shall not be reproduced except in full.



#### 綜合試驗有限公司 SOILS & MATERIALS ENGINEERING CO., LTD.

G/F., 9/F., 12/F., 13/F. & 20/F., Leader Centre, 37 Wong Chuk Hang Road, Abardeen, Hong Kong. 香港黃竹坑道37號利達中心地下,9樓,12樓,13棵及20樓 E-mall: smec@cigismec.com Website: www.cigismec.com Tel: (852) 2873 6860 Fax: (852) 2555 7533



#### CERTIFICATE OF CALIBRATION

Certificate No.:

05CA0708 01-07

Page:

of

2

Item tested

Description:

Sound Calibrator (Class 1)

Manufacturer:

Rion Co., Ltd.

Type/Model No.: Serial/Equipment No.:

10307216 / N.004.06

Adaptors used:

\_

Item submitted by

Client:

Maunsell Environmental Management Consultants Ltd.

Request No.:

Date of request:

08-Jul-2005

Date of test:

13-Jul-2005

Reference equipment used in the calibration

Traceable to: Explry Date: Serial No. Description: Model: NIM 10-Nov-2005 **B&K 4180** 2341427 Lab standard microphone NIM **B&K 2673** 2239857 09-Nov-2005 Preamplifier 09-Nov-2005 NIM 2346941 Measuring amplifier **B&K 2610** NIM 06-Jun-2006 Signal generator DS 360 61227 SCM U\$360B7050 22-Nov-2005 34401A Digital muiti-meter NIM GB41300350 08-Nov-2005 Audio analyzer 8903B MY40003662 08-Jun-2008 MIM Universal counter 53132A

Ambient conditions

Temperature:

23±1°C

Relative humidity:

60 ± 10 %

Air pressure:

1000 ± 10 hPa

#### Test specifications

The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B
and the lab calibration procedure SMTP004-CA-156.

The calibrator was tested with its axis vertical facing downwards at the specific frequency using equivalent insert voltage

technique.

The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference
pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure
changes.

#### Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942; 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on page 2 of this certificate.

Approved Signatory:

luang Jian Min

Date: 13-Jul-2

Company Chon


Comments: The results reported in this pertificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

O Soils & Materials Engineering Co., Ltd.

Form No.CARP156-1/lssue 1/Rev.C/01/05/2005

Hong Kong Accreditation Service (HKAS) has accredited this laboratory under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS Directory of Accredited Laboratories. The results shown in this certificate were determined by this laboratory in accordance with its terms of accreditation. Such terms of accreditation stipulate that the results shall be traceable to the International System of Units (S.I.) or recognised measurement standards. This certificate shall not be reproduced except in full.

APPENDIX F AIR QUALITY MONITORING RESULTS AND GRAPHICAL PRESENTATION

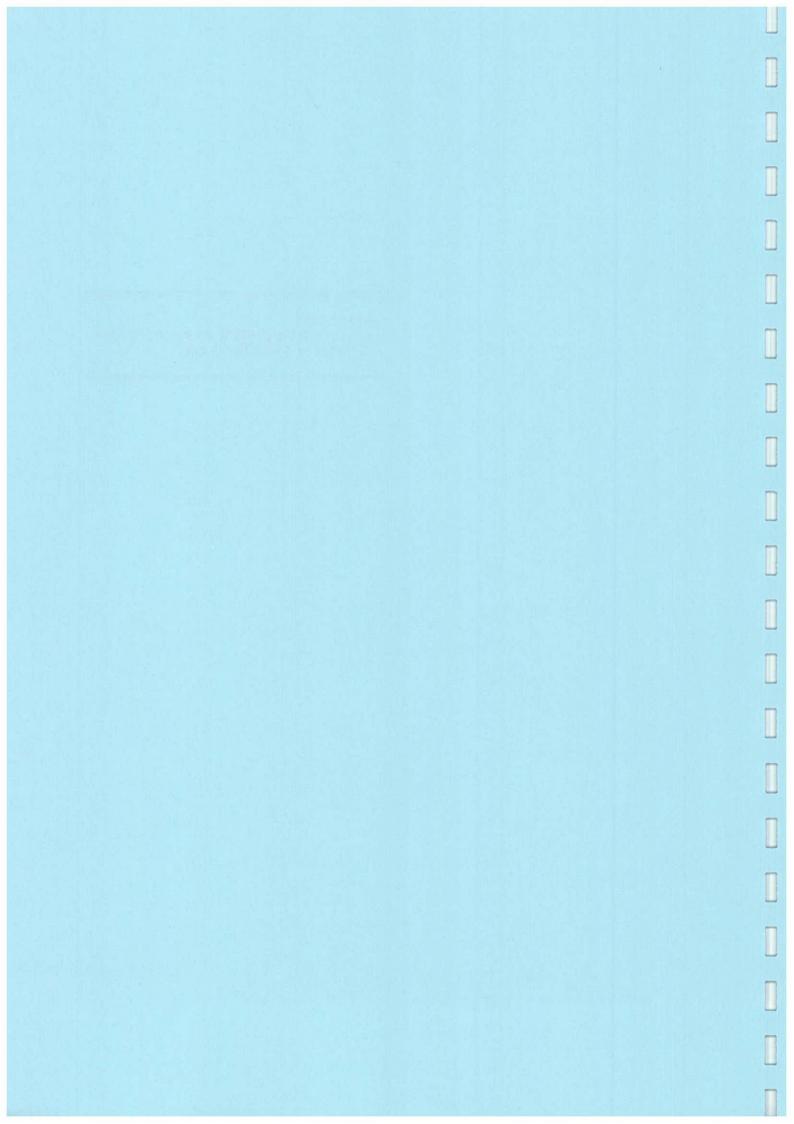

#### **APPENDIX F: Air Quality Monitoring Results**

1-hour TSP Monitoring Results at Station ASR8

1-11001 101	MOIIILOIII	19 11004.11			
Date	Starting		Concentra	tion, µg/m3	
	Time	1st	2nd	3rd	Average
3-Jun-06	8:00	114.5	113.5	116.5	114.8
9-Jun-06	9:00	114.3	111.4	112.2	112.6
15-Jun-06	14:05	135.7	139.0	144.2	139.6
21-Jun-06	9:35	106.7	112.2	112.4	110.4
27-Jun-06	13:35	95.2	92.9	98.6	95.6
	·			Min.	92.9
				Max.	144.2
				Average	114.6

1-hour TSP Monitoring Results at Station ASR17

, ,a	Monte				
Date	Starting		Concentra	tion, μg/m3	
	Time	1st	2nd	3rd	Average
3-Jun-06	8:00	109.8	112.0	111.4	111.1
9-Jun-06	9:00	121.5	117.3	119.3	119.4
15-Jun-06	14;0	130.0	135.2	136.7	134.0
21-Jun-06	9:42	95.2	98.9	101.6	98.6
27-Jun-06	14:55	114.7	113.2	110.0	112.6
<u> </u>	·			Min.	95.2
				Max.	136.7
				Average	115.1

Remark:

Bold value indicated an Action level exceedance Bold & Italic value indicated an Limit level exceedance

# APPENDIX F: Air Quality Monitoring Results

## 24-hour TSP Monitoring Results at Station ASR8

Date	Filter W	Filter Weight (g)	Flow Rate (m³/m	(m³/min.)	Elapse	Elapse Time	Sampling	Conc.	Weather	Particulate		Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(hg/m³)	Condition	weight(g)	(m³/min)	(m°)
2-Jun-06	3.6382	3.7189	1.37	1.37	2606.2	2630.2	24.0	40.8	Cloudy	0.08	1.37	1977.1
8-Jun-06	3.6236	3.6471	1.12	1.12	2630.2	2654.2	24.0	14.5	Rainy	0.02	1.12	1618.6
14lun-06	3.5806	3.6590	1.41	1.41	2654.2	2678.2	24.0	38.8	Fine	0.08	1.41	2023.2
20-hin-06	3 6269	3 6748	1.37	1.37	2678.2	2702.2	24.0	24.2	Sunny	0.05	1.37	1977.1
26-hin-06	3.5722	3.6212	1.28	1.28	2702.2	2726.2	24.0	26.6	Sunny	0.05	1.28	1843.2
30-Jun-06	3.4492	3.4744	1.25	1.25	2726.2	2750.2	24.0	14.0	Sunny	0.03	1.25	1798.6
							Min	14.0				
							Max	40.8				
							Average	26.5				


## 24-hour TSP Monitoring Results at Station ASR17


Date	Filter Weight (g)	eight (g)	Flow Rate (m	(m³/min.)	Elapse	Elapse Time	Sampling	Conc.	Weather	Particulate	Av. flow	Total vol.
	Initial	Final	Initial	Final	Initial	Final	Time(hrs.)	(mg/m³)	Condition	weight(g)	(m³/min)	(m²)
2-Jun-06	3.6417	3.7253	1.49	1.49	16701.4	16725.4		38.9	Cloudy	90.0	1.49	2148.5
8-Jun-06	3.6440	3.6806	1.37	1.37	16725.4	16749.4		18.5	Rainy	0.04	1.37	1975.7
14-Jun-06	3.5708	3.6487	1.43	1.43	16749.4	16773.4	24.0	37.8	Fine	0.08	1.43	2062.1
20-Jun-06	3.6061	3.6580	1,43	1.43	16773.4	16797.4		25.2	Sunny	0.05	1.43	2062.1
26-lun-06	3.5739	3.6251	1.37	1.37	16797.4	16821.4	24.0	25.9	Sunny	0.05	1.37	1975.7
30-Jun-06	3,4732	3.5284	1.28	1.28	16821.4	16845.4	24.0	29.9	Sunny	90'0	1.28	1846.1
							Min	18.5				
							Max	38.9				

38.9 29.4

Average

Remark: Bold value indicated an Action level exceedance Bold & Italic value indicated an Limit level exceedance

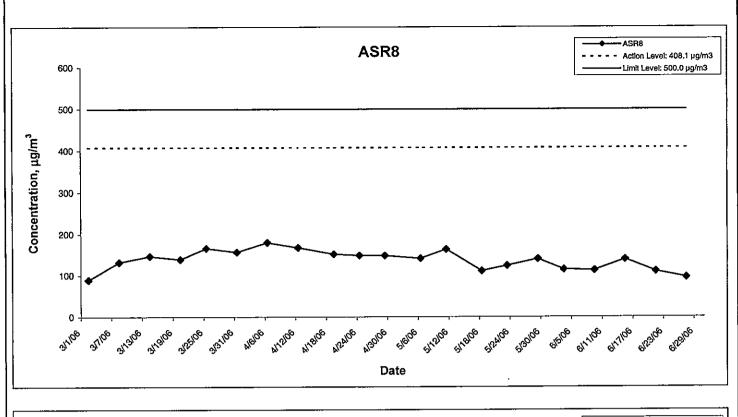

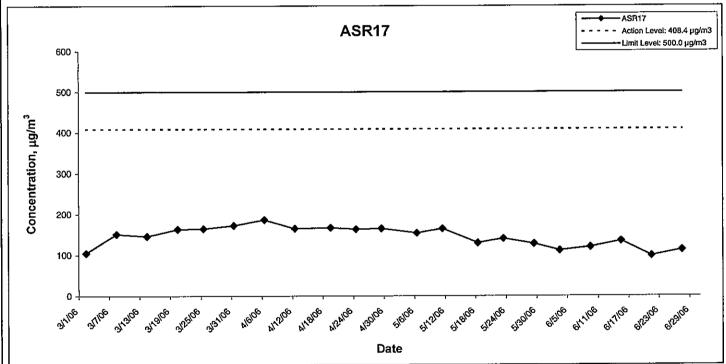

MAUNSELL AECOM

Maunsell Environmental


Management Consultants Ltd

Contract No. SS M333 Reprovisioning of Diamond Hill
Crematorium


Graphical Presentation of 1-hour TSP

Graphical Presentation of 1-hour TSP
Monitoring Results for Location ASR8 and
ASR17

	SCALE	N.T.S.	DATE	2006	
	CHECK	FLWY	DRAWN	LLMC	
	JOB NO.		APPENDI:	X	Rev
		\$07904	F		-

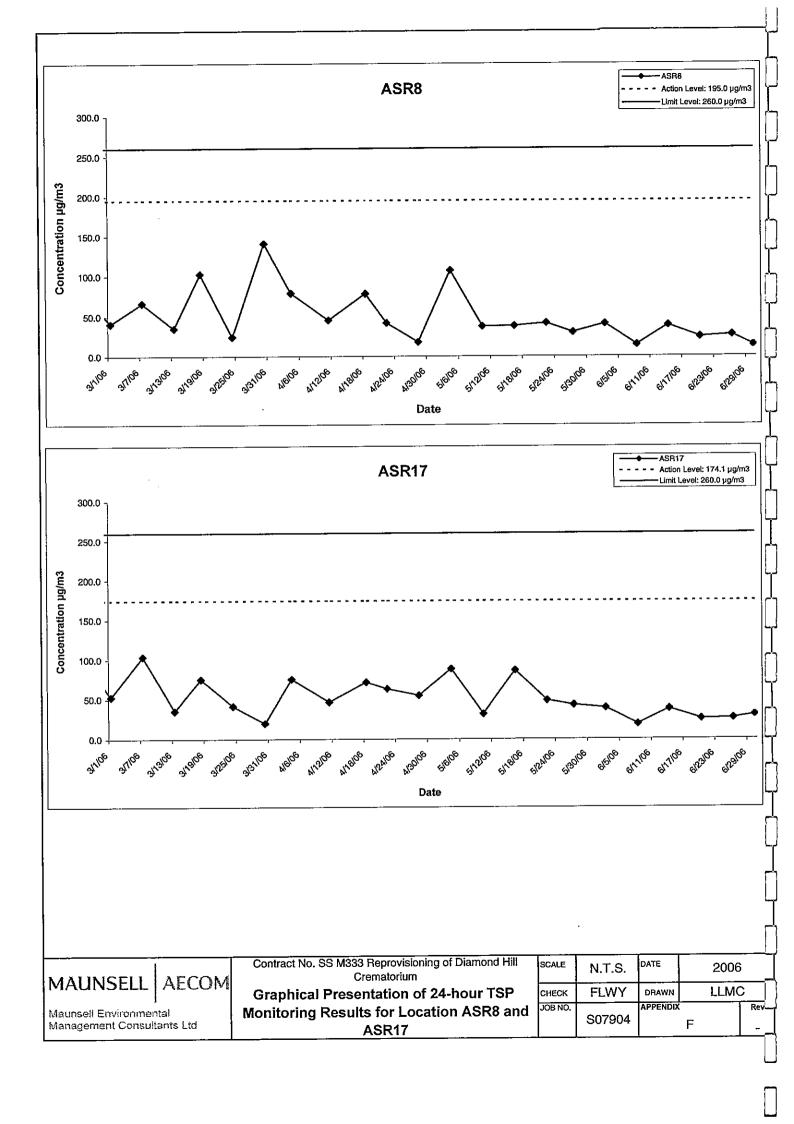

APPENDIX G NOISE MONITORING RESULTS AND GRAPHICAL PRESENTATION

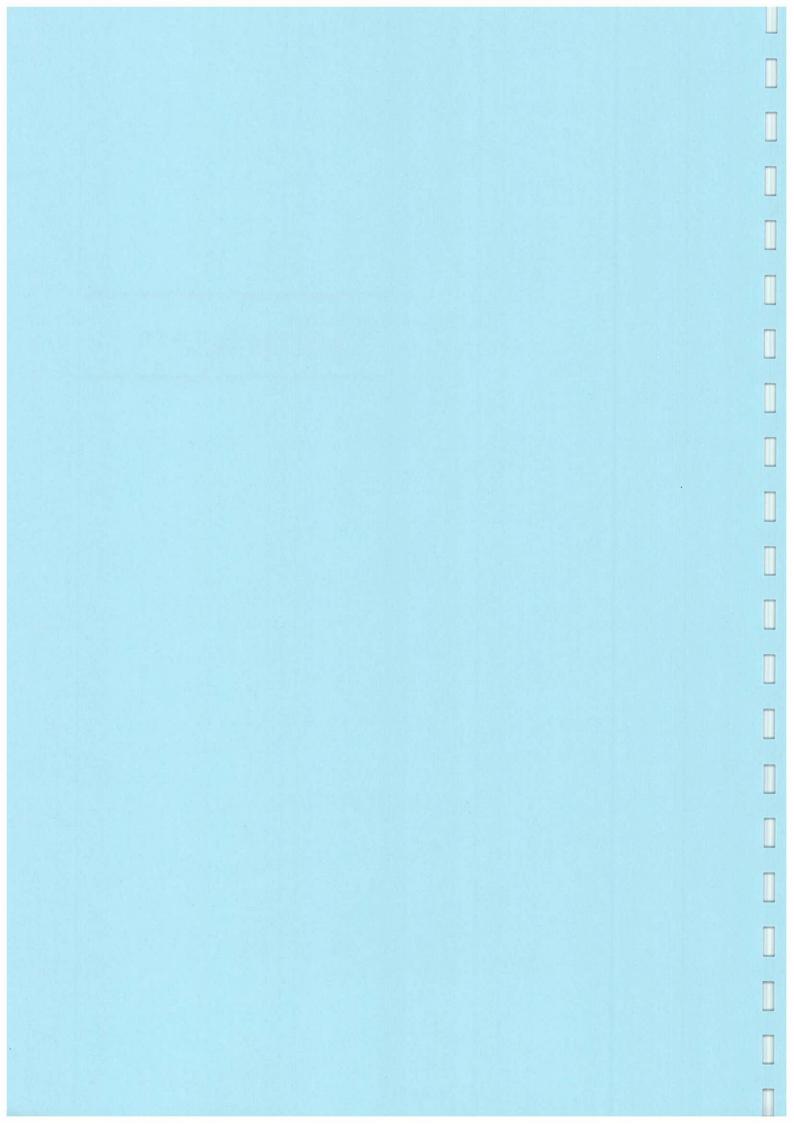

# Appendix G Noise Monitoring Results

Daytime Noise Monitoring Results at Station SR3

Weather		Noise Level for 30-min, dB(A) <sup>+</sup>				Baseline Noise	Calculated Construction Noise	Limit Level.	Exceedance
Date	Condition	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		Level, dB(A)	dB(A)	(Y/N)			
3-Jun-06	Cloudy	8:55	62.0	66.2	64.1	65.1	*Note	70	N
10-Jun-06	Cloudy	13:52	62.5	67.5	65.0	65.1	*Note	70	N
15-Jun-06	Fine	14:10	60.2	65.0	63.7	65.1	*Note	70	N
21-Jun-06	Sunny	11:15	63.0	66.7	64.9	65.1	*Note	70	N .
27-Jun-06	Sunny	14:15	59.0	66.2	63.7	65.1	*Note_	70	N
<u></u>		Min	59.0	65.0	63.7				
		Max	63.0	67.5	65.0				
		Average	61.3	66.3	64.3	]			

# Daytime Noise Monitoring Results at Station SR4

Weather		Noise Level for 30-min, dB(A) <sup>+</sup>				Baseline Noise	Calculated Construction Noise	Limit Level.	Exceedance
Date	Condition	Time	L90	L10	Leq	Level, dB(A)	Level, dB(A)	dB(A)	(Y/N)
3-Jun-06	Cloudy	8:45	62.0	66.5	64.0	65.6	*Note	70	N
10-Jun-06	Cloudy	13:45	61.8	66.2	64.5	65.6	*Note	70	N
15-Jun-06	Fine	14:05	59.1	64.2	62.6	65.6	*Note	70	N
21-Jun-06	Sunny	10:30	62.3	66.2	64.1	65.6	*Note	70	N
27-Jun-06	Sunny	13:35	60.1	67.1	65.0	65.6	*Note	70	N
		Min	59.1	64.2	62.6				
		Max	62.3	67.1	65.0	][			
		Average	61.1	66.0	64.0				

# Daytime Noise Monitoring Results at Station SR6

Date Weather		Noise Level for 30-min, dB(A) <sup>+</sup>				Baseline Noise	Calculated Construction Noise	Limit Level,	Exceedance
Date	Condition	Time	L90	L10	Leq	Level, dB(A)	Level, dB(A)	dB(A)	(Y/N)_
3-Jun-06	Cloudy	8:00	60.8	65.0	62.1	68.5	*Note	75	N
10-Jun-06	Cloudy	13:00	60.0	64.5	62.4	68.5	*Note	75	N
15-Jun-06	Fine	16:00	59.3	65.3	64.2	68.5	*Note	75	N_
21-Jun-06	Sunny	9:42	61.3	65.0	63.2	68.5	*Note	75	N
27-Jun-06	Sunny	14:55	57.5	63.4	61.0	68.5	*Note	75	N
,		Min	57.5	63.4	61.0			.,	
		Max	61.3	65.3	64.2	1			

62.6

64.6


59.8

+ - Façade measurement


Bold & Italic value indicated an Limit level exceedance

Note: Measured noise level is less than the baseline noise level.

Average

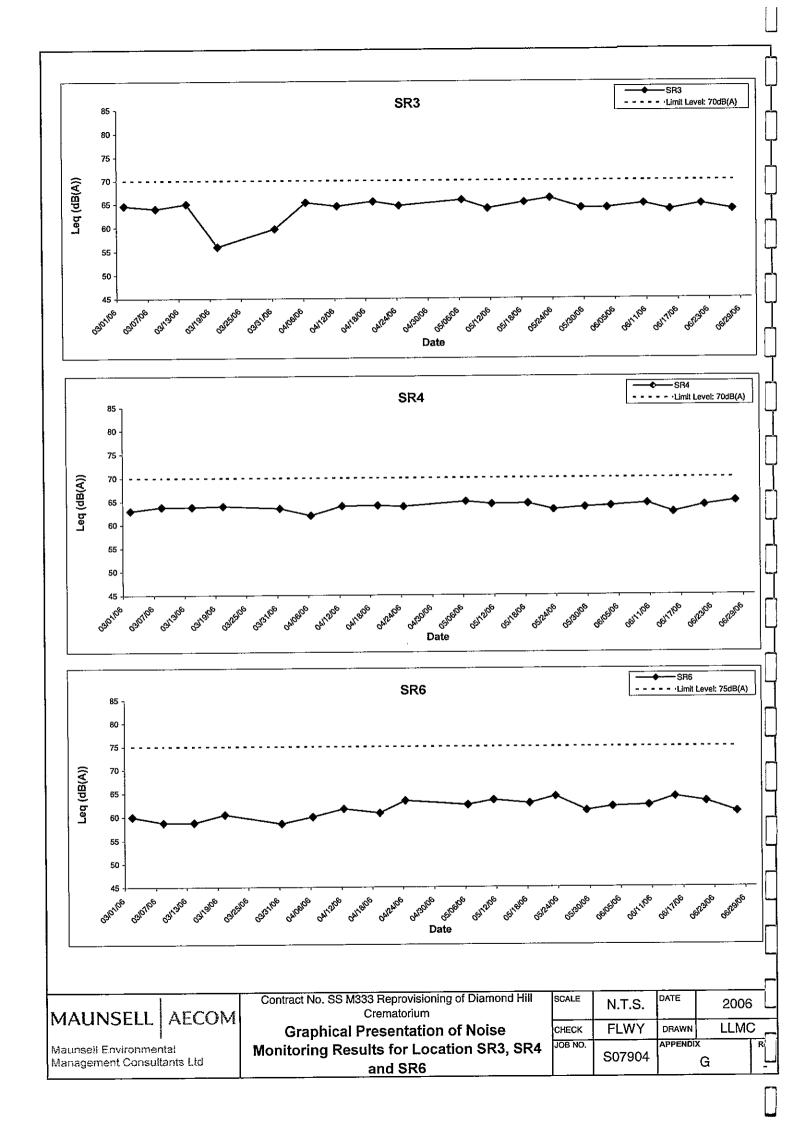

APPENDIX H
SUMMARY OF WEEKLY ENVIRONMENTAL
SITE INSPECTION OBSERVATIONS

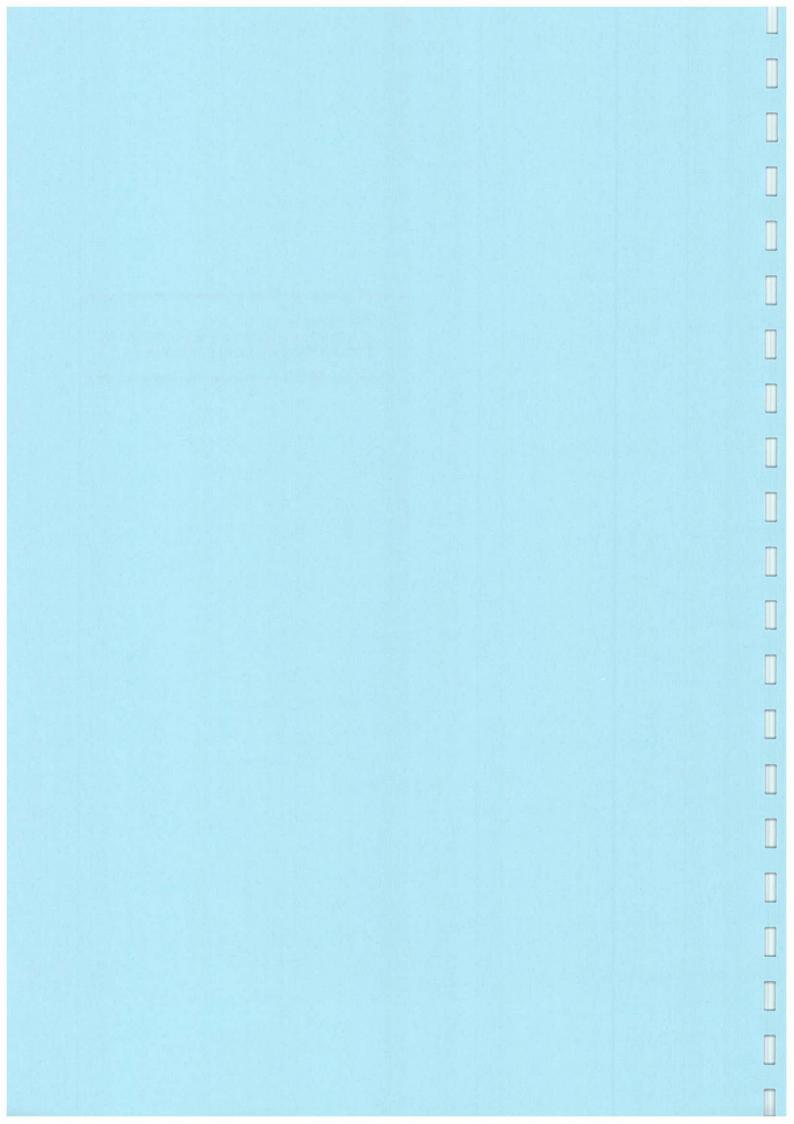

# Appendix H Summary of Weekly Environmental Site Inspection Observations

### Inspection Information

Date	1 June 2006
Time	10:05 am - 11:30 am

#### Remarks/Observations

#### Water Quality

 The wheel washing facilities were not well maintained. The contractor was reminded to maintain it well as soon as possible.

#### Air Quality

Following the previous inspection, temporary exposed slopes were properly covered.

#### Noise

3. No violation was observed in this site inspection.

#### Waste/Chemical Management

- 4. Following the previous inspection, general refuse was disposed properly and regularly.
- Following the previous inspection, the chemical wastes were stored in proper storage areas.
- Some water was stored in chemical waste storage area. The contractor was reminded to clean it as soon as possible.

# Landscape and Visual

7. No violation was observed in this site inspection.

#### Others

8. No violation was observed in this site inspection.

#### Inspection Information

Date	7 June 2006
Time	09:30 am – 10:30 am

#### Remarks/Observations

#### Water Quality

1. The wheel washing facilities was under maintenance.

#### Air Quality

2. Following the previous inspection, temporary exposed slopes were dampened.

#### Noise

3. No violation was observed in this site inspection.

#### Waste/Chemical Management

- 4. Following the previous inspection, general refuse was not observed.
- 5. Some water was not observed in chemical waste storage area.
- 6. Stagnant water / water pondings was observed inside the site. The Contractor was reminded to remove the stagnant water or apply mosquitoes oil to prevent mosquitoes breeding.

#### Landscape and Visual

7. No violation was observed in this site inspection.

#### Others

8. No violation was observed in this site inspection.

nspection Information					
Date	14 June 2006				
Γime	09:30 am — 10:30 am				
Remarks/Observation	· S				
Water Quality					
	ning facilities was under maintenance.				
_	/ water pondings in the open area of AGV had been cleared.				
<ol><li>Stagnant water was found on the 1st Floor platform. The Contractor was reminded to remove the stagnant water to prevent mosquitoes breeding.</li></ol>					
Air Quality	to provont moodanood brooding.				
	s observed in this site inspection.				
Noise	- shows ad in this site increasion				
Waste/Chemical Manag	s observed in this site inspection.  nement				
•	s observed in this site inspection.				
Landscape and Visual					
7 Nandalatian	s observed in this site inspection.				
	3 Observed III tills site inapositori.				
Others  8. No violation wa	s observed in this site inspection.				
Others  8. No violation was  nspection Information  Date	s observed in this site inspection.  19 June 2006				
Others  8. No violation was  nspection Information  Date	s observed in this site inspection.				
Others  8. No violation was  nspection Information  Date	s observed in this site inspection.  19 June 2006  09:30 am - 12:00 pm				
Others  8. No violation was  Inspection Information  Date  Time	s observed in this site inspection.  19 June 2006  09:30 am - 12:00 pm				
Others  8. No violation was served in the server of the se	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.				
Others  8. No violation was specified in Information  Date Time  Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.  was found on the Ground Floor and 1st Floor. The Contractor was reminded to				
Others  8. No violation was Inspection Information Date Time  Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water remove the sta	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.				
8. No violation was Inspection Information Date Time Remarks/Observation Water Quality 1. The wheel was 2. Stagnant water remove the sta	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.  was found on the Ground Floor and 1st Floor. The Contractor was reminded to				
8. No violation was spection Information Date Time Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water remove the sta  Air Quality 3. Debagging/gros	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.  was found on the Ground Floor and 1st Floor. The Contractor was reminded to gnant water to prevent mosquitoes breeding.				
8. No violation was  Inspection Information  Date Time  Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water remove the state Air Quality 3. Debagging/growenclosed works  Noise	19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance. was found on the Ground Floor and 1st Floor. The Contractor was reminded to gnant water to prevent mosquitoes breeding.  ut mixing was observed without enclosure. The Contractor was reminded to provide thop for grout mixing activities to prevent emission of dust.				
8. No violation was  Inspection Information  Date Time  Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water remove the star Air Quality 3. Debagging/growenclosed works  Noise 4. No violation was	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.  was found on the Ground Floor and 1st Floor. The Contractor was reminded to gnant water to prevent mosquitoes breeding.  ut mixing was observed without enclosure. The Contractor was reminded to provide shop for grout mixing activities to prevent emission of dust.  s observed in this site inspection.				
8. No violation was Inspection Information Date Time Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water remove the star Air Quality 3. Debagging/growenclosed works  Noise 4. No violation was  Waste/Chemical Managements	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance.  was found on the Ground Floor and 1st Floor. The Contractor was reminded to gnant water to prevent mosquitoes breeding.  ut mixing was observed without enclosure. The Contractor was reminded to provide shop for grout mixing activities to prevent emission of dust.  s observed in this site inspection.				
8. No violation was  Inspection Information  Date Time  Remarks/Observation  Water Quality  1. The wheel was 2. Stagnant water remove the stare and a processed works  Air Quality 3. Debagging/ground enclosed works  Noise 4. No violation was  Waste/Chemical Manage 5. Broken sandba	In June 2006  Og:30 am – 12:00 pm  selection as found on the Ground Floor and 1st Floor. The Contractor was reminded to grant water to prevent mosquitoes breeding.  In this gracilities was under maintenance.  The Contractor was reminded to grant water to prevent mosquitoes breeding.  In this gracilities was reminded to provide shop for grout mixing activities to prevent emission of dust.  In this site inspection.  In this site inspection.  In this site inspection.				
8. No violation was Inspection Information Date Time Remarks/Observation Water Quality 1. The wheel was 2. Stagnant water remove the star Air Quality 3. Debagging/groenclosed works Noise 4. No violation was Waste/Chemical Manage 5. Broken sandba The Contractor Landscape and Visual	s observed in this site inspection.  19 June 2006 09:30 am – 12:00 pm  s  hing facilities was under maintenance. was found on the Ground Floor and 1st Floor. The Contractor was reminded to gnant water to prevent mosquitoes breeding.  ut mixing was observed without enclosure. The Contractor was reminded to provide shop for grout mixing activities to prevent emission of dust.  s observed in this site inspection.  gement gs were observed at site entrance and general refuse was observed scattered on site. was reminded to improve housekeeping on site.				
8. No violation was Inspection Information Date Time Remarks/Observation Water Quality 1. The wheel was 2. Stagnant water remove the star Air Quality 3. Debagging/groenclosed works Noise 4. No violation was Waste/Chemical Manage 5. Broken sandba The Contractor Landscape and Visual	In June 2006  09:30 am – 12:00 pm  selection and 1st Floor. The Contractor was reminded to grant water to prevent mosquitoes breeding.  In this grace was observed without enclosure. The Contractor was reminded to grant water to prevent mosquitoes breeding.  In this grace was observed without enclosure. The Contractor was reminded to provide shop for grout mixing activities to prevent emission of dust.  In this site inspection.  In this site inspection.				

# Inspection Information

Date	26 June 2006
Time	09:30 am – 12:00 pm

#### Remarks/Observations

### Water Quality

- 1. Maintenance work at wheel-washing bay had completed.
- 2. Stagnant water on the G/F and L/F had been removed.

#### Air Quality

- 3. Grout mixing was not observed.
- 4. Open grout mixing material bag was found without cover. The Contractor was reminded to provide cover or properly store the open grout mixing material.

#### Noise

5. No violation was observed in this site inspection.

# Waste/Chemical Management

- 6. Broken sandbags had been removed. However, general refuse was still found accumulated at various locations on site.
- 7. Stockpiles of construction waste were observed on site. The Contractor was reminded to remove the construction waste regularly.


# Landscape and Visual

8. No violation was observed in this site inspection.

#### Others

9. No violation was observed in this site inspection.


APPENDIX I STATUS OF ENVIRONMENTAL PERMITS/LICENCES

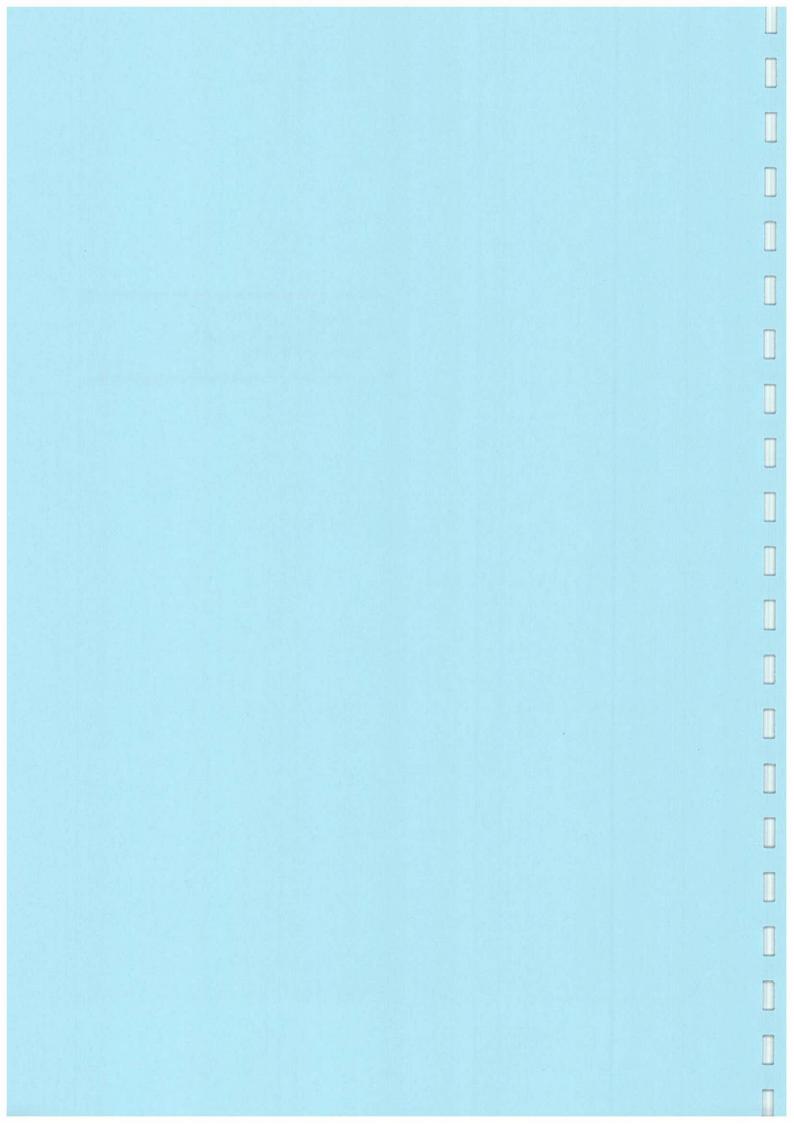

# Appendix I Status of Environmental Permits/Licenses

Dameit Na	Valid	Period			Status		
Permit No.	From	То	]	Sectio	, , ,		Siatus
<b>Environmental Per</b>	mit & Furth	er Environn	nental Permit				
EP-179/2004/B	14 Feb 2005	N/A	Reprovisioning Crematorium	of	Diamond	Hill	Valid
Registration as a C	hemical Wa	ste Produc	er	_	•		
5213-288-C3108- 10	6 Dec 2004	N/A	Reprovisioning Crematorium	of	Diamond	Hill	Valid
Water Discharge L	icense						
RE/C0202/288/1	9 Mar 2005	31 Mar 2010	Reprovisioning Crematorium	of	Diamond	Hill	Valid
<b>Construction Nois</b>	e Permit						
GW-RE0003-06	10 Feb 2006	9 Jul 2006	Reprovisioning Crematorium	of	Diamond	Hill	Valid
GW-RE0164-06	10 Jul 2006	9 Dec 2006	Reprovisioning Crematorium	of	Diamond	Hill	Valid

APPENDIX J
IMPLEMENTATION SCHEDULE OF
MITIGATION MEASURES

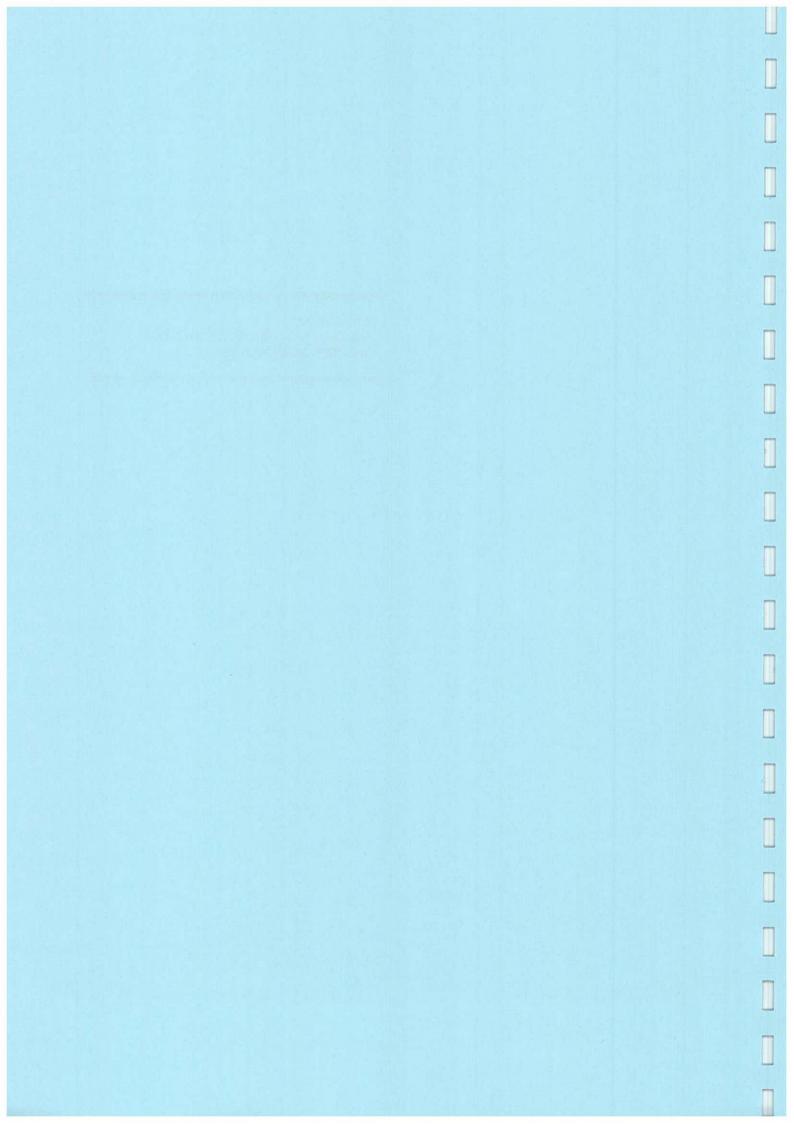

# Appendix J – Environmental Mitigation Implementation Schedule

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Air Quality Mitigation Measures					<u> </u>
Special air pollution control systems shall be installed and operate to reduce the emissions of air pollutants to acceptable levels	New cremators in New Crematorium	Arch SD	Design, Construction, Demolition and Operation stage	BPWAPCO	1
FEHD shall apply for a Specified Process License under the APCO	New Cremators in the New Crematorium / prior to operation	FEHD	Construction, Demolition and Operation stage	APCO	N/A
The efflux velocity of chimney shall be at least 15 m/s, the design diameter of the chimneys shall be 0.22 m and 0.30 m, the design chimney height shall be 101mP.D. (28.5m above ground), for 170 kg and 250 kg cremators respectively	Chimney of New Crematorium / design and construction stages	Arch SD	Design and Construction stage	BPM/APCO	N/A
If the interior wall of existing cremators and chimney are confirmed dioxins contaminated, special precautions shall be taken avoid fugitive emissions of dioxin contaminated materials	Cremator room and chimney in Existing Crematorium / demolition	Arch SD/Contractor	Demolition stage		N/A
Sufficient water spraying should be applied during the construction work, the fugitive dust generated from general construction dust would be reduced by 90%	Project site / construction and demolition stages	Arch SD, contractor	Construction and Demolition stage	APCO	1
Carry out a confirmatory test of dioxins in the depositions on chimney wall, flue gas ducting and combustion chambers when the existing Crematorium is shut down	Chimney, flue and cremators in Existing Crematorium / decommissioning	FEHD, Arch SD	Demolition stage		N/A
If the dioxin level of surface deposition is between 1 and 10 ppb I-TEQ, it is classified as moderately contaminated with dioxins. The demolition work site should be covered up to avoid emission of fugitive dust during demolition	Chimney, flue and cremators in Existing Crematorium / decommissioning	Arch SD 3	Demolition stage		N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
If the dioxin level of surface deposition exceeds 10 ppb I-TEQ, it is classified as severely dioxin-contaminated waste. If it is confirmed that the existing facilities are severely contaminated with dioxins, a special decommissioning method — Containment method — would be adopted	Chimney, flue and cremators in Existing Crematorium / decommissioning	Arch SD 3	Demolition stage		. N/A
All the demolition waste would be carefully handled, sealed and treated as chemical waste. The waste collector shall be responsible for preventing fugitive dust emission when handling the demolition waste	Chimney, flue and cremators in Existing Crematorium / demolition stage	Arch SD, contractor	Demolition stage		1
Employ a registered asbestos contractor to remove asbestos containing material during the demolition of the existing crematorium building	Cremator room in Existing Crematorium / decommissioning	Arch SD, contractor	Demolition stage	APCO	N/A
Submit a formal AIR and Asbestos Abatement plan signed by a registered asbestos consultant to the Authority for approval under APCO 28 days prior to the start of any asbestos abatement work.	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A
When removing asbestos containing materials, enclosure of the work area; containment and sealing for the asbestos containing waste; provision of personal decontamination facility; use of personal respiratory/protection equipment; use of vacuum cleaner equipped with highefficiency air particulate (HEPA) filter for cleaning up the work area; and carry out air quality monitoring during the asbestos abatement work	Cremator room in Existing Crematorium I decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A
Appoint qualified personnel to carry out the asbestos containing material removal work, including a registered asbestos contractor to carry out the work; a registered asbestos supervisor to supervise the work; a registered asbestos laboratory to monitor the air quality, and a registered asbestos consultant to supervise and certify the asbestos abatement work.	Cremator room in Existing Crematorium / decommissioning	Arch SD, consultant	Demolition stage	APCO	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Erect a site barrier with the height of no less than 2.4m to enclose the construction site Apply frequent water spraying to ensure the surface of the construction site sufficiently wet to reduce fugitive dust due to wind erosion and transportation on unpaved haul road Cover up stockpiles of fill material and dusty material Install a vehicle-cleaning system at the main entrance of the construction site to clean up the vehicles before leaving the site The Air Pollution Control (Construction Dust) Regulation shall be followed for fugitive dust control	Project site I construction and demolition stages	Contractor	Construction and Demolition stage	APCO, Air Pollution Control (Construction Dust) Regulation	•
No more than 6 cremators (including both the existing and new ones) are in operation during commissioning lest of new cremators.  The commissioning test of each new cremator shall be recorded by a log book	Existing and new cremators in Exiting and New Crematorium / text and commissioning	Arch SD/FEHD/ Contractor	Construction stage		N/A
Special air pollution control systems shall be installed and operate to reduce the emissions of air pollutants to acceptable levels	New cremators in New Crematorium / all stages	Arch SD	Design, Construction, Demolition and Operation stage	BPM/APCO	N/A
Conduct baseline and regular 1-hour and 24-hour TSP monitoring.	A8 and A17 / baseline monitoring prior to Phase I & II works and regular monitoring throughout Phase I & II works	Contractor	Construction and Demolition stage	APCO, EM&A Guidelines for Development Projects in Hong Kong	1
When the demolition material is confirmed to have ACM, monitoring for asbestos fibre would be carried out at the boundary of the construction site for reassurance purposes as per the requirement of future	Construction site boundary / demolition	Contractor	Demolition stage	Asbestos Study Report, AIR and AAP to be submitted under	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
icense for asbestos abatement, though it is not expected that asbestos fibre would be liberated from the demolition of the Existing Crematorium building.				APCO, future licence for asbestos abatement (if any)	
Noise Mitigation Measures Select quiet plant, which is defined as PME with a sound power level lower than that specified in GW-TM. Examples of quiet plant can be referred to those listed in British Standard BS5228.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	GW-TM	1
Where practicable, use movable barriers of 3 to 5 m height with a small cantilevered upper portion and skid footing can be located within a few metres from a stationary plant (e.g. generator, compressor, etc.) and within about 5 m for a mobile equipment (e.g. breaker, excavator, etc.), especially in the vicinity of SR3, SR4 and SR6. The purpose-built noise barriers or screens shall be constructed of appropriate materials with a minimum superficial density of 15kg/m2.	Project site i construction and demolition stages	Contractor	Construction and Demolition stages	NCO	N/A
<ul> <li>Only well-maintained plant should be operated on site and plant should be regularly serviced during the construction works</li> <li>Plant that is used intermittently should be turned off or throttled down when not in active use</li> <li>Plant that is known to emit noise strongly in one direction should be oriented to face away from NSRs</li> <li>Silencers, mufflers and enclosures for plant should be used where possible and maintained adequately throughout the works</li> <li>Where possible mobile plant should be sited away</li> </ul>	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	NCO	

Recommended Mitigation Measures	Location and Timing	Who to implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works					
Liaise with the school and the Examination Authority to ascertain the dates and times of examination periods during the course of the construction/ demotition works so as to avoid any noisy activities during these periods. Programme of the on-site works should hence be well programmed such that the noisier construction activities would not be coincided with the examination of the schools.	Project site / construction and demolition stages	Contractor	Demolition stage	NCO	1
Conduct regular noise monitoring.	SR 3, SR 4 and SR 6 / Phase I & II works	Contractor	Demolition stage	NCO, EM&A Guidelines for Development Projects in Hong Kong	٧
Land Contamination Mitigation Measures Additional site investigations in areas of the site that are currently in use and cannot be readily accessed. These investigations will be carried out once the existing facility has been decommissioned. The additional site investigations are required in the vicinity of the existing CLP secondary substation, and around the cremators and flues inside the crematorium building. Once access to these areas is available, a sampling and analysis plan will be prepared for approval by EPD, additional investigations will take place, and the need for remedial works will be determined. Any remedial works required will be in addition to those described in this current report.	CLP secondary substation and cremator room/ demolition stage (Phase I – CLP secondary substation; Phase II – cremator room)	Contractor	Demolition stage	ProPECC PN 3/94	1
Once the Existing Crematorium has ceased operating during Phase II, confirmatory surface	Locations S1 to S6 specified in the	Contractor	Demolition stage	ProPECC PN 3/94	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
samples will be taken from the samples points S1 to S6 at a depth of 0.1m, and these samples will be analysed for the same suite of determinands (i.e. dioxins, metals and PAH) in order to confirm that no further contamination has occurred. The Remediation Action Plan will be revised on the basis of these results.	CAP/demolition				
The underground fuel storage tank and associated pipework will be removed as part of the site formation works. The base of the excavations will be inspected during and after tank removal by a suitably experienced environmental specialist in order to determine whether there is any visual or olfactory evidence of fuel contamination. If such contamination is suspected, then confirmatory soil sampling will be carried out, and the samples analysed for TPH.	Underground fuel storage tank/during and after tank removal	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Summary of remediation works at locations S3 and S5:					
Mark out 5m radius around S3 and S5 2. Excavate to depth of 0.5m 3. Transport to landfill site for final disposal4. Take 4 samples from edges of excavation and one sample from base of excavation, analyse for lead and tin 5. If the results exceed Dutch B Levels, extend excavation to a further 5 m radius and 0.5 m depth in the quadrant where the contaminated samples is encountered and repeat steps 3 and 4 6. If the results less than Dutch B Levels, then remediation completed.	Locations S3 and S5 specified in CAP/demolition	Contractor	Demolition stage	ProPECC PN3/94	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
During removal of the underground fuel storage tank, appropriate precautions should be taken to avoid contamination. All fuel tanks and associated pipework should be emptied prior to any demolition work being undertaken. Any remaining sludge or sediment in the tanks or pipework should be removed and disposed of as chemical waste in accordance with the appropriate regulations for disposal of such material.	Underground fuel storage tank / Phase II demolition	Agent Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Fitting Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Should contamination be encountered beneath the fuel tank or the CLP secondary substation, further remedial work will be required. Such potential contamination would consist of either TPH (in the case of the fuel tank) or PCBs (in the case of the CLP secondary substation). As a realistic worst-case estimate, the PCB contaminated soil at CLP secondary substation may require stabilisation with cement prior to disposal to landfill. A realistic worst case estimate is that the volume of TPH contaminated soil at underground storage tank would require landfill disposal.	CLP secondary substation /Phase I demolition and underground fuel tank / Phase II demolition	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N/A
Health and Safety Precautions during Remedial Works					
The site workers engaged in the remedial works should be provided with adequate personal protective equipment, which should include: Protective foolwear; Gloves: Dust masks; and Overalls. A clean area should be provided, equipped with washing facilities. Eating, drinking and smoking should only be permitted within designated "clean" areas after washing. Excavated material should not be stockpiled, but should immediately be treated/transported to landfill on a daily basis.	All areas requiring remedial works in Project site / demolition during Phases I and II	Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling	N/A

Recommended Mitigation Measures	Location and Timing	Who to implement?	When to implement?	What Requirements or Standards to Achieve?	Status
· · · · · · · · · · · · · · · · · · ·				Workshops	
Avoidance of Impacts on Water Quality during Remedial Works In order to avoid impacts on water quality during remedial works, care will be taken to minimise the mobilisation of sediment during excavation and transport. Measures to be adopted will be based on the recommendations set out in Practice Note for Professional Persons ProPECC PN1/94 "Construction Site Drainage". The results of the site investigation suggest that there is unlikely to be any requirement for dewatering of excavations, since groundwater was not encountered in any of the exploratory holes. The contractor carrying out the remedial works will be required to submit a method statement detailing the measures to be taken to avoid water quality impacts. Typical measures would include; • Carry out the works during the dry season (i.e. October to March) if possible; • Use bunds or perimeter drains to prevent run-off water entering excavations; • Sheet or otherwise cover excavations whenever rainstorms are expected to occur; • Minimise the requirements for stockpiling of material and ensure any stockpiles are covered; • Temporary on-wit stockpiles are covered: • Temporary on-wit stockpiles are sovered: • Temporary on-wit stockpiles on tomainated on a daily basis; • Ensure that any discharges	All areas requiring remedial works in Project site I demolition during Phases I and II	Agent Contractor	Demolition stage	ProPECC PN 3/94, ProPECC PN1/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismandling Workshops	N/A
Waste Disposal Requirements during Remedial	1		1		Î
Works An application for permission to dispose of excavated material should be made to the Facilities Management Group of EPD three months prior to disposal. A "tripticket" system should be implemented. Each load of contaminated soil despatched to landfill should be	All areas requiring remedial works in Project site / demolition during Phases I and II	Contractor	Demolition stage	ProPECC PN 3/94, Waste Disposal Ordinance (Cap. 354), WBTC No. 21/2002 and	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
accompanied by an admission ticket. Vehicles leaving the site should be adequately sheeted to prevent dispersion of contaminated material during transport. The wheels of vehicles should be cleaned prior to leaving site, to prevent contaminated material leaving site on the wheels of vehicles.				Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	
Compliance Report for Remedial Works Following completion of remediation works, a Remediation Report should be compiled and submitted, to demonstrate that the remediation works have been carried out in accordance with the Remediation Action Plan. The Remediation Report should include details of the excavation works carried out, records of material taken to landfill, and results of confirmatory testing, and should be submitted to EPD for approval before the commencement of building works.	All areas requiring remedial works in Project site / after completion of remediation works	Agent Contractor	Demolition stage	ProPECC PN 3/94 and Guidance Notes for Investigation and Remediation of Contaminated Sites of Petrol Filling Stations, Boatyards and Car Repair / Dismantling Workshops	N∕A
Land Contamination Mitigation Measures Conduct supplementary site investigation for TPH and PCB in soil samples.	CLP substation / after decommissioning but prior to demolition during Phase I work	Contractor	Demolition stage	CAR, RAP, future sampling and analysis plan	1
Conduct confirmatory testing of PAH, dioxins and metals (the "Dutch List") in soil samples.	S1 to S6 / Phase II work	Contractor	Construction and Demolition stages	CAR, RAP, future sampling and analysis plan	N/A
If fuel contamination underneath the underground fuel tank is suspected, confirmatory soil sampling will be carried out for analysis of TPH.	Underneath the underground fuel tank / Phase II	Contractor	Demolition stages	CAR, RAP, future sampling and analysis plan	N/A
Conduct confirmatory testing of tin and lead in soil	S3 and S5 / during	Contractor	Construction and	CAR, RAP, future	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
samples to confirm all contaminated soil has been excavated.	Phase II work following excavation at each location		Demolition stages	sampling and analysis plan	
Waste Management Mitigation Measures Good Site Practice Obtain relevant waste disposal permits from the appropriate authorities, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation (Cap. 354) and the Land (Miscellaneous Provision) Ordinance(Cap. 28) Prepare a Waste Management Plan approved by the Engineers / Supervising Officer of the Project in accordance with Environment, Transport and Works Bureau Technical Circular (Works) (ETWBTC(W)) 15/2003, Waste Management On Construction Sites Nominate an approved person, such as site manager, to be responsible for good site practice, arrangements for collection and effective disposal of all types of wastes generated on-site to appropriate facility Use waste haulier authorized or licensed to collect specific category of waste Establish trip ticket system as contractual requirement (with reference to Works Branch Technical Circular (WBTC) No. 21/2002) for monitoring of public fill and C&D waste at public filling facilities and landfills. Such activities should be monitored by the Environmental Team Provide training to site staff in terms of proper waste management and chemical waste handling procedures Separate chemical wastes for special handling and dispose them at licensed facility for treatment Establish routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors Provide sufficient waste disposal points and regular	Project site/ design, construction and demolition stages	Contractor	Design, Construction and Demolition stages	Waste Disposal Ordinance (Cap. 354), Waste Disposal(Chemical Waste) (General) Regulation(Cap. 354) Land(Miscellaneou s Provision) Ordinance(Cap. 28) WDO, ETWBTC(W) 15/2003, WBTC No. 21/2002	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
collection for disposal  • Adopt measures to minimize windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers  • Establish recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites)					
Waste Management Plan The contractor should submit the Waste Management Plan to Engineer/Supervising Officer of the Project for approval. The Waste Management Plan should describe the arrangements for avoidance, reuse, recovery and recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the activities of the Project and indicate the disposal location(s) of all waste. A trip ticket system shall be included in the Waste Management Plan.	Project site / design, construction and demolition stages	Contractor	Design, Construction and Demolition stages	Waste Disposal Ordinance (Cap. 354)	7
Waste Reduction Measures • Minimize the damage or contamination of construction material by proper storage and site practices • Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste • Prior to disposal of C&D waste, wood, steel and other metals should be separated for reuse and / or recycling to minimize the quantity of waste to be disposed of to landfill • Minimize use of wood and reuse non-timber formwork to reduce the amount of C&D waste • Recycle any unused chemicals or those with remaining functional capacity as far as practicable • As far as practicable, segregate and store different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal • Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors, separate labeled	Project site / construction and demolition stages	Agent Contractor	Construction and Demolition stages	WBTC No. 32/92, 5/98 and 19/99	7

1	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
bins should be provided to help segregate this waste					•
from other general refuse generated by the work force Excavated Material Rock and soil generated from excavation should be reused for site formation as far as possible. In addition, excavated material from foundation work can be reused for landscaping as far as practicable to avoid disposal off-site.	Project site / construction and demolition stages	Contractor	Construction and Demolition stages	WBTC 12/2000	1
Construction and Demolition Material Careful design, planning and good site management can minimize over-ordering and generation of waste materials such as concrete, mortar and cement grouts. Standard formwork should be used as far as practicable, wooden formwork should be replaced by metal ones whenever possible. Alternatives such as plastic fencing and reusable site office structures can also minimize C&D waste generation. The contractor should recycle as much as possible of the C&D material on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Materials such as concrete and masonny can be crushed and used as fill and steel reinforcing bar can be used by scrap steel mills. Different areas of sites should be designated for such segregation and storage. To maximize landfill life, government policy discourages the disposal of C&D materials with more than 20% inert material by volume (or 30% inert material by weight) at landfill. Inert C&D material (public fill) should be directed to an approved public filling area, where it has the added benefit of offsetting the need for removal of materials from borrow areas for	Project site I construction and demolition stages	Contractor	Design, Construction and Demolition stages	WBTC 5/98 and19/99	
reclamation purposes.  Contaminated Material – Further Contamination	CLP secondary	Contractor	Demolition	ProPECC PN	N/A

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status	
Location	Investigation Parameter	Investigation Period	_				
Cremators/ flue/chimney and surrounding areas	Asbestos (building structure)	Phase II					
CLP secondary substation	PCB, TPH (soil samples)	Phase I					
Cremators/ flue/chimney and surrounding areas	Dioxins, heavy metals, PAH (ash waste)	Phase II					
Surface soil around Existing Crematorim	Dioxins, heavy metals, PAH (soil sample)	Phase II					
information on at cremators /	materials requiring	mination well as the quantity of					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Samples of ash/particulate matters should be collected from within the cremators (including the bottom ash), chimney walls, flues and surrounding area of the Existing Crematorium for analysis of dioxin, heavy metals and PAHs by a HOKLAS accredited laboratory. A consultant experienced in the abatement of chemical wastes particularly the handling of DCM, should be appointed in order to assist with the evaluation of the information and prepare an abatement plan for the ash waste. Such a plan shall be submitted to EPD and the Labour Department (LD) to establish an acceptable and safe method for these potentially hazardous wastes. The abatement plan should identify the method of abatement, the performance criteria for the protection of workers and the environment and any emergency procedures and contingency measures required. It must be ensured that the treatment of ash wastes will comply with all routine construction site safety procedures would apply as well as statutory requirements under the Occupational Safety and Health Ordinance and Factories and Industrial Undertakings Ordinance. Due to the difficulties in establishing permanent and effective engineering controls, the protection of workers is likely to be at the worker level. A safe system of work must be provided, and training and suitable personal protective equipment as well as hyglenic	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition stage	ProPECC PN 3/94	N/A
decontamination facilities should be provided. It is recommended that the methods to be adopted by the contractor for disposal of the ash waste should be agreed with LD and EPD.					
Sufficient time should be allocated to abate all ash waste with DCM/HMCM/PAHCM. The contractor should ensure the implications of dust				ProPECC PN 3/94 Code of Practice on	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
containing DCM/HMCM on air quality and workers health during the clean up work are mitigated. Since DCM is chemically related to Polychlorinated Biphenyl (PCB) wastes, the requirements of the Code of Practice on the Handling, Transportation and Disposal of (PCB) Wastes should be referenced when developing the abatement plan.				the Handling, Transportation and Disposal of (PCB) Wastes	
A land contamination site investigation was carried out under this EIA to determine disposal requirements for contaminated soil. Further site investigation on soil around CLP secondary substation is needed when decommissioned, which will be during Phase I of the works. In addition, confirmatory testing on DCM level in locations \$1 to \$6 will be required to identify the appropriate remediation and disposal requirements during Phase II of the works.	Locations S1 to S6 in CAP / prior to Phase II demolition		Demolition stage		N/A
Asbestos Containing Materials (ACM) Further asbestos assessment should be carried out when access to the cremators /flue /chimney is accessible after decommissioning and before demolition. An AMP should be prepared. The AAP should be prepared and submitted to EPD for approval prior to commencement of demolition works in accordance to the APCO. It is preferable to remove all ACM before actual demolition. A registered asbestos removal contractor should be employed to remove all ACM in accordance with the approved AAP which will be prepared in due course in accordance with the Code of Practice (COP) on Asbestos Control for Safe Handling of Low Risk ACM and Asbestos Work Using Full Containment or Mini Containment Method published by EPD. A registered asbestos consultant should also be employed to	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition stage	Code of Practice (COP) on Asbestos Control for Safe Handling of Low Risk ACM and Asbestos Work Using Full Containment or Mini Containment Method COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal	N∕A

15
----

Recommend	commended Mitigation Measures		Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
the contracto on Handling, Waste under	supervise abatement works. For the disposal of ACM, the contractor should observe the COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal (Chemical Waste) (General) Regulation.					(Chemical Waste) (General) Regulation APCO	
Dioxin Contal Containing M Polyaromatic (PAHCM) fro Crematorium	ining Materials (DCM laterials (HMCM) / Hydrocarbon Contain m Demolition of the E Intamination Classific MCM	) / Heavy Metal ning Materials xisting	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Demolition	ProPECC PN3/94 USEPA dioxin assessment criterion	N/A
Low/Non Contaminat ed by DCM/ HMCM/ PAHCM	< 1 ppb TEQ	. < Dutch "B" List					
Moderately/ Severely Contaminat ed HMCM / PAHCM	< 1 ppb TEQ	≥ Dutch "B" List					
Moderately Contaminat ed DCM	≥ 1 and <10 ppb TEQ	Any level					

Recommend	Recommended Mitigation Measures		Location and Timing	Who to implement?	When to implement?	What Requirements or Standards to Achieve?	Status
Severely Contaminat ed DCM	≥10 ppb TEQ	Any level					
Low/Non-Co. PAHCM from Where the as DCM/HMCM should avoid demolition. G measures m All such ash disposal of a Subject to th investigation ash waste is	PAHCM, the contra- ash waste becoming beneral dust suppres entioned in Section 4 waste can be directly	MCM / ing Crematorium without contaminated ctor g airborne during sion be should be followed. Y there as bestos where such atted with as bestos	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	APCO	N/A
Demolition, I Moderately C Moderately/S from Demolit Crematorium Procedure of disposal of N	landling, Treatment Contaminated DCM a Severely Contamination of the Existing In demolition, handlin loderately Contaminaterately/Severely C	and Disposal of and ed HMCM / PAHCM g, treatment and	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommended Mitigation Measures		Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
Site Preparation	The contractor should ensure the impacts of dust containing dioxin and/or heavy metals on air quality and workers health during the handling and transportation of the contaminated materials are mitigated. Except the cremators/flue/chimney, all removable items where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is identified should be removed as far as practicable to avoid obstructing the decontamination activities. Preliminary site decontamination of all debris shall be carried out using HEPA vacuum cleaner. The top portion of the chimney above the roof shall be enclosed by a chamber with three layers of polyethene sheets. At the entrance to the cremators /flues /chimney, a 3-chamber decontamination unit shall be constructed for entry and exit from the work area.  The 3-chamber decontamination unit shall comprise a dirty room, a shower room and a clean room of at least fm x 1m base each with 3 layers of fire retardant polyethene sheet where all workers shall carry out decontamination procedures before leaving the work area. Warning signs in both Chimese and English should be put up in conspicuous areas.					

Recommende	Recommended Mitigation Measures		Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Decontamin ation, demolition and	All workers shall wear full protective equipment, disposable protective coverall (such as Tyvek) (with hood and shoe covers), nitrile gloves, rubber boots (or boot covers), and full-face positive pressure respirators equipped with a combination cartridge that filters particulate and removes organic vapour. The organic vapour protection is an added protection against the unlikely exposure to any vapour. If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above site preparation.  The cremators/flue/chimney shall be removed from top down starting from the chimney. Any ash or residues attached to the cremators/flue/chimney	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
handling	or any other building structures shall be removed by scrubbing and HEPA vacuuming. Wastes generated from the containment or decontamination unit including the protection clothing of the workers such as the coveralt, nitrile glove, rubber boots and materials used for wet wiping shall be disposed of at landfill site.					

Recommende	ed Mitigation Measures	Location and Timing	Who to implement?	When to implement?	What Requirements or Standards to Achieve?	Status
12	After completion of removal, decontaminate all surfaces by HEPA vacuum.					
Treatment	If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be imptemented prior to the above decontamination, demolition and handling measures.  The ash waste contains dioxin/heavy metals and in its untreated state would be classified as a chemical waste under the Waste Disposal (Chemical Waste) (General) Regulation. While the quantity of DCWHMCM is not expected to be significant, the levels of dioxin and heavy metals would affect the treatment option. Immobilization of the contaminated materials by mixing with cement followed by disposal at landfill (if landfill disposal criteria can be met) would be the most preferable option.  Rather than treating the already					
:	incinerated ash waste by incineration, the ash waste with moderately contaminated					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
DCM or moderately/severely contaminated HMCM / PAHCM should be collected and stabilized to meet landfill disposal criteria of the Facilities Management Group (FMG) of EPD. In this case it is envisaged that the process would involve collection and mixing of the ash waste with cement. Pilot mixing and TCLP tests should be carried out to establish the appropriate ratio of cement to ash waste to the satisfaction of EPD. It is envisaged that the pilot tests would involve the mixing of say 5%, 10% and 15% ratios of cement to ash waste and three replicate of 300 mm cube blocks for each ratio. TCLP tests should then be used to establish the correct ratio of cement to ash waste to the satisfaction of EPD.					

Recommen	ded Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Disposal	After immobilization of the ash waste by mixing with cement in the correct ratio as determined by the pilot mixing and TCLP test, the waste materials should be placed inside polyethene lined steel drums for disposal at landfill.  Transparent plastic sheeting of 0.15 mm thickness low-density polyethene or PVC should be employed. The drums should be 16 gauge steel or thicker and fitted with double bung fixed ends adequately sealed and well labelled in new or good condition. The drums should be clearly marked "DANGEROUS CHEMICAL WASTE" in English and Chinese. Prior agreement of the disposal criteria from the FMG of EPD and agreement to disposal from the landfill disposal criteria cannot be met after immobilization of the ash waste, disposal at the CWTC should be considered.  The building structures will be disposal of at landfill.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

Recommende	ed Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achleve?	Status
	If ACM is identified in building structures where moderately contaminated DCM or moderately/severely contaminated HMCM / PAHCM is found, relevant disposal measures for building structures described in the AAP (see 7.7.16) should be implemented instead.					
Severely Cont Demolition of a Procedure for	andling, Treatment and Disposal of aminated DCM from the Existing Crematorium demolition, handling, treatment and werely Contaminated DCM	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
Item	Procedure			-		
Site Preparation	Except the cremators/flue/chimney, all removable items where severely contaminated DCM is identified should be removed from the cremator room as far as practicable to avoid obstructing the decontamination activities. Preliminary site decontamination of all debris shall be carried out using HEPA vacuum cleaner. The walls, floor and ceiling of the cremator room where severely contaminated DCM located shall be lined with 3 layers of fire retardant polyethene sheets. The top portion of the chimney above the roof shall be enclosed by a chamber with three layers of polyethene sheets. At the entrance to the cremators/flues/chimney, a 3-chamber					

Recommended Mitigation Measures	Location and Timing	Who to implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
decontamination unit shall be constructed for entry and exit from the work area. The 3-chamber decontamination unit shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base each with 3 layers of fire retardant polyethene sheet where all workers shall carry out decontamination procedures before leaving the work area. Warning signs in both Chinese and English should be put up in conspicuous areas.  Air movers should be installed at the cremator room, and at the bottom of the chimney to exhaust air from the work area. A stand-by air mover shall also be installed with each of the air movers. Sufficient air movement shall be maintained to give a minimum of 6 air changes per hour to the work area, and maintain a negative pressure of 0.05-0.15 inches of water within the work area throughout the entire course of the decommissioning works. A pressure monitor with printout records and audible alarm shall be installed at an easily accessible location to demonstrate tha negative pressure is maintained. New pre-filters and HEPA filters shall be used on the air movers.					
A copy of the maintenance records of					

Recommended Mitigation Measures	Location and Timing	Who to implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
the air movers should be kept on site for inspection upon request. The appointed contractor shall also check the differential pressure of the air mover to make sure the filter is not blocked. A differential pressure above 0.2 inches of water indicates that the filters would need to be changed.					N/A
Smoke Test: before commencement of the decommissioning work, a smoke test with non-toxic smoke shall be carried out to ensure the air-tightness of the containment. Also check whether there are stagnant air pockets indicated by an aggregate of smoke that cannot effectively be extracted. After a successful test, switch on the air mover to exhaust smoke from the containment and to give a minimum of 6 air changes per hour, and check visually to see that the filters screen out the smoke effectively and if the pressure gauges read normal. If not, the air mover shall be sealed up and returned to the supplier workshop for necessary servicing, and replaced by a tested air mover. The normal reading pressure range for maintaining 6 air changes per hour shall be 1.5-4 mm/0.05-0.15 inches of water or equivalent	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

4	c	ı	ī	2
1	=		-	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
(negative pressure). The audible alarm's integrity should also be checked at the trigger shall be at <1.5 mm/0.0 inches of water (negative pressure). Otherwise securely seal up alt openings before switching off the air mover.  Treatment of WasterWorkers Safet Protection: the contractor shall be required to register as a Chemical Waster Producer. All workers shall wear fur protective equipment, disposable protective coverall (such as Tyvek) (with hoo and shoe covers), nitrile gloves, rubber boot boot covers), and full-face positive pressure respirators equipped with combination cartridge that filters	S d s (or				
particulate and removes organic vapour. The organic vapour protect is an added protection against the unlike exposure to any vapour as a necessary measure.					
If ACM is identified in building structures where severely contaminated DCM is found, relevant abatement meas for building structures described in AAP (see 7.7.16) should be implemented prior to the above sit preparation.	i the				

Recommend	ed Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
Decontamin ation, demolition and handling	The cremators/flue/chimney shall be removed from top down starting from the chimney. Any ash or residues attaching to the cremators/flue/chimney or any other building structures shall be removed by scrubbing and HEPA vacuuming.  The detached sections of the building structures where severely contaminated DCM is located shall be wrapped with 2 layers of fire retardant polyethene sheets. A third layer shall then be wrapped and secured with duct tape. Decontaminate the outer layer of the wrapped flue sections by wet wiping.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A
	Wastes generated from the containment or decontamination unit including the fire retardant polyethene sheets, protection clothing of the workers such as the coverall, nitrile glove, rubber boots and materials used for wet wiping shall be disposed of at landfill site.	Cremator room in Existing Crematorium / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	NA

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
The quantity of wastewater generated from the decontaminated process will be very small but the contractor should take precautionary measures as to minimize the quantity of contaminated water arising. Nevertheless, if any contaminated wastewater needs to be discharged out of the site, it has to be properly treated to WPCO requirements with prior agreement from EPD on discharge standards.  After completion of removal, decontaminate the surface where severely contaminated DCM was located, including the wrapped incinerator furnace and flue sections left within the containment, by wet wiping and HEPA vacuum.  Then spray the innermost layer of the fire retardant polyethene sheet covering the wall, ceiling and floor with PVA. Upon drying, peel off this innermost layer of the polyethene sheet covering the containment and dispose of at landfill site.					

Recommende	d Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
	Repeat the above decontamination procedure for the second innermost layer of fire retardant polyethene sheet by wet wiping and HEPA vacuuming. After spraying with PVA, peel off this second innermost layer of the polyethene sheet covering the wali, ceiling and floor and dispose of at landfill site. Finally, the last layer of polyethene sheet shall then be taken down after spaying with PVA and be disposed as contaminated wastes.					
	If ACM is identified in building structures where severely contaminated DCM is found, relevant abatement measures for building structures described in the AAP (see 7.7.16) should be implemented prior to the above decontamination, demolition and handling measures.	Cremator room in	Contractor	Demolition stage	Waste Disposal	N/A
Treatment and disposal	Waste to be disposed to CWTC: all contaminated ash waste with severely contaminated DCM removed and the used HEPA filters shall be sent to CWTC in Tsing Yi. The total volume should be confirmed by further site investigation.	Existing Crematorium / demolition	Contractor	Demonsor stage	(Chemical Waste) (Chemical Waste) (General) Regulation	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
Waste to be Disposed of at Landfill: other wastes including the building structures and its associated panels at well as wastes generated from this decommissioning works are also considered as contaminated waste and shall be disposed of at a designated landfill. Wastes generated from this decommissioning works refer to the polyethene wrapping sheets for the building structures, waste generated from the dismantlement of the containment and decontamination units, and cloth used in wet wrapping, etc. as previously described in this section. They shall be placed into appropriate containers such as drums, jerricans, or heavy duty and leak-proof plastic as a prudent approach.  A disposal permit has to be obtained from the Authority. The disposal trip ticket is required to be made available as record after disposal.  If ACM is identified in building structures where severely contaminated DCM is found, relevant disposal measures of the above disposal measures.					

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to implement?	What Requirements or Standards to Achieve?	Status
Dioxin Containing Materials (DCM) / Heavy Metal Containing Materials (HMCM) / Polyaromatic Hydrocarbon Containing Materials (PAHCM) / Total Petroleum Hydrocarbon Containing Materials (TPHCM) / Polychlorinated Biphenyls Containing Materials (PCBCM) from Soil Remediation at the Project Site					
According to the CAR and RAP, less than 100 m3 of soil would require disposal at landfill. Relevant health and safety procedure, waste disposal requirements and compliance report are as detailed in Figure 6.3. Mitigation measures to avoid fugitive dust emission mentioned in S.4.7.2 should also be observed.	Locations S3 and S5 of CAP / demolition	Contractor	Demolition stage	ProPECC PN3/94 APCO	N/A
In addition, after decommissioning but before demolition of the Existing Crematorium, further investigations during Phase I of the works at the vicinity of CLP secondary substation should also be carried out to determine if additional remediation (in addition to the current RAP) is required. Confirmatory test on levels of DCM, HMCM and PAHCM in locations S1 to S6 during Phase II of the works is also required to determine any further remediation //reatment/disposal. In addition, the ash waste in cremator/chimney/flues should also be collected for the testing of DCM/HMCM/PAHCM during Phase II of the works. The sampling and analysis plan should be prepared and submitted to EPD for approval.	before demolition	Contractor	Demolition stage	ProPECC PN3/94	N/A
All the aforementioned ACM / DCM / HMCM / PAHCM / TPHCM / PCBCM are classified as chemical waste. In addition to the measures mentioned above, the packaging, labelling and storage practices of chemical waste as stipulated in the following paragraphs should also be applied to these contaminated materials.	Project site / demolition	Contractor	Demolition stage	Waste Disposal (Chemical Waste) (General) Regulation	N/A

•	4
3	1

Recommended Mitigation Measures	Location and	Who to	When to	What	Status
Necotime and Magazini measure	Timing	Implement?	Implement?	Requirements or Standards to Achieve?	
Chemical Waste All the chemical waste should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The Contractor should register as a chemical waste producer. The chemical waste should be stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation. Containers used for the storage of chemical waste should:	Project site / demolition	Contractor	Demolition stage	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes, Waste Disposal (Chemical Waste) (General) Regulation.	•
<ul> <li>Be suitable for the substance they are holding, resistant to corrosion, maintained in good condition, and securely closed;</li> </ul>					
<ul> <li>Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and</li> </ul>					
<ul> <li>Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation.</li> </ul>	. <u></u>				
The storage area for chemical waste should:	Ì				
<ul> <li>Be clearly labeled and used solely for the storage of chemical waste;</li> </ul>					
<ul> <li>Be enclosed on at least 3 sides;</li> </ul>					
<ul> <li>Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest;</li> </ul>					
Have adequate ventilation;		ı			1
Be covered to prevent rainfall from entering (water collected within the bund must be tested and disposal as chemical waste if necessary); and					
Be properly arranged so that incompatible			<u> </u>		

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
materials are adequately separated.  The chemical waste should be disposed of by:  • A licensed waste collector;  • A facility licensed to receive chemical waste, such as the CWTC at Tsing Yi, which offers chemical waste collection service and can supply the necessary storage containers; and/or  • A waste recycling plant as approved by EPD.	Project site / demolition	Contractor	Demolition stage	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Waste Disposal (Chemical Waste) (General) Regulation.	N/A
General Refuse General refuse should be stored in enclosed bins or compaction units separated from C&D and chemical wastes. A reliable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimize odour, pest and litter impacts. The burning of refuse on construction sites is prohibited by law.  Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated or easily accessible. Therefore, separately labeled bins for deposit of these cans should be provided if feasible. Similarly, plastic bottles and carton package material generated on-site should be separated for recycling as far as practicable. Site office waste should be reduced through recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered if one is available.	Project site / construction and demolition stages	Contractor	Construction and Demolition stage		•
Conduct supplementary site investigation for asbestos in building structures and for dioxins, metals (the "Dutch List") and PAH in ash/particular	Around existing cremators, chimney and flues	Contractor	Demolition stage	AIR, AMP/AAP to be submitted under	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
matter samples.	inside cremator room / after decommissioning but prior to demolition during Phase II work			APCO, future supplementary site investigation plan	
Landscape and Visual Mitigation Measures					
The identification of the landscape and visual impacts will highlight those sources of conflict requiring design solutions or modifications to reduce the impacts and, if possible, blend the development with the surrounding landscape. The proposed landscape mitigation measures will be described and illustrated by means of site plans and photomontage and take into account factors including:	Project site / design, construction and demolition stages	Contractor/FEH D/Arch SD	Construction and Demolition stage	EIAO-TM	N/A
Screen planting					
<ul> <li>Transplanting of mature trees with good amenity value where appropriate</li> </ul>					
Conservation of topsoil for reuse					
<ul> <li>Sensitive alignment of structures to minimise disturbance to surrounding vegetation</li> </ul>					
<ul> <li>Reinstatement of areas disturbed during construction</li> </ul>					
<ul> <li>The design and finishes / colours of architectural and engineering structures such as terminals and pylons</li> </ul>					
<ul> <li>Existing views, views of the development with no mitigation, views with mitigation at day one of operation and after 10 years of operation</li> </ul>					
Tree transplanting: The tree survey has identified the trees which will be affected by the development and which could be considered for	Project site / construction and demolition as well	Contractor/Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
transplanting prior to commencement of construction work. Felling is considered as a last resort and every effort should be made to transplant the many good trees of high amenity value to either nearby suitable sites within the cemetery or to available space in FEHD's Wo Hop Shek Crematorium pending identification of an alternative site. The feasibility of transplanting will depend on a number of factors such as size, health and species of the tree. Adequate time (a minimum of 4 months) should be allowed for preparing trees for transplanting. Weekly inspection of tree protection measures as well as monitoring of tree transplant operations during both phases should be implemented. Particular care should be taken to save the 9 nos. mature and semi-mature protected tree species and 12 nos. protected shrub and immature tree species the best possible chance of survival it is recommended that they are relocated to sheltered and well maintained planted areas within the cemetery. The following measures for tree transplanting should be adopted: (a) Appoint a landscape contractor for the establishment and maintenance of the transplanted trees as well as any new tree planting for 12 months upon completion of the works.  (b) Careful co-ordination of Phase I and II works to allow tree transplanting from Phase II site directly to Phase I site.	as operation stages	Arch SD	Construction and	WBTC 7/2002.	I N/A
Tree protection: Trees to be retained adjacent to works areas will be carefully protected by strong hoarding and if necessary additional protection to individual tree trunks to avoid damage by machinery. The hoarding will also prevent	Project site / construction and demolition stages	AIGIOD	Demolition stage	WBTC 14/2002, EIAO-TM	

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
contractors from compacting soil around tree roots or dumping materials. Reference should be made to the guidelines for tree protection in the Government publication "Tree Planting and Maintenance in Hong Kong".					
Topsoil conservation: Any topsoil excavated during construction will be carefully saved and stored to one side of the works area for reuse upon completion.	Project site / upon completion of construction works for each phase	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A
Replanting: Upon completion planting of ornamental trees and shrubs will be provided to the periphery of the new crematorium building to help screen and soften the overall appearance of the structure. In addition, a reprovisioned memorial garden with a lotus pond and omamental planting will be incorporated in the deck area of the building. Since the majority of the new planting will be on the deck structure the selection of species will be more limited with emphasis on smaller trees and ornamental shrubs to comply with loading restrictions. Notwithstanding this site constraint on tree selection, a minimum of 1.2m soil depth will be provide for tree planting on the podium / roof structure for healthy establishment of the new tree planting.	Project site / upon completion of construction works for each phase	Arch SD	Construction and Demolition stage	WBTC 7/2002, WBTC 14/2002, EIAO-TM	N/A
Weekly inspections of tree protection measures as well as monitoring of tree transplant operations.	Project site / Phase I & II works	Project Landscape Architect	Construction and Demolition stage	Landscape Master Plan, Tree Planting and Maintenance in Hong Kong	N/A
Water Quality Mitigation Measures	1				
Construction and Demolition Phases – General To safeguard the water quality of the WSRs potentially affected by the Project works, the	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	4

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
contractor should implement appropriate mitigation measures with reference to the Practice Note for Professional Persons, Construction Site Drainage (ProPECC PN 1/94) published by EPD, Such measures are highlighted as follows.					
Construction and Demolition Phases - Construction and Demolition Run-off and Drainage Exposed soil areas should be minimized to reduce the potential for increased sillation, contamination of run-off and erosion. Any effluent discharge from the Project site is subject to the control of Water Pollution Control Ordinance (WPCO) discharge license and should be treated to meet the discharge standard set out in the relevant license. In addition, no site run-off should enter the stream on the eastern side of the Project site. Run-off impacts associated with the construction and demolition activities can be readily controlled through the use of appropriate mitigation measures, which include:	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	4
<ul> <li>Temporary ditches should be provided to facilitate run-off discharge into appropriate watercourses, via a silt retention pond</li> </ul>					
<ul> <li>Boundaries of earthworks should be marked and surrounded by dykes</li> </ul>					
<ul> <li>Open material storage stockpiles should be covered with tarpaulin or similar fabric to prevent material washing away</li> </ul>					
<ul> <li>Exposed soil areas should be minimized to reduce the potential for increased siltation and contamination of run-off</li> </ul>					
<ul> <li>Earthwork final surfaces should be well compacted and subsequent permanent work should be immediately performed</li> </ul>					
<ul> <li>Use of sediment traps wherever necessary</li> </ul>		1		<u> </u>	


Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
Maintenance of drainage systems to prevent flooding and overflow					
All temporary drainage pipes and culverts provided to facilitate run-off discharge should be adequately designed to facilitate rapid discharge of storm flows. All sediment traps should be regularly cleaned and maintained. The temporarily diverted drainage should be reinstated to its original condition, when the construction/demolition work is completed.					٧
Sand and silt in wash water from wheel washing facilities should be settled out and removed from discharge into temporary drainage pipes or culverts. A section of the haul road between the wheel washing bay and the public road should be paved with backfall to prevent wash water or other site run-off from entering public road thrains.					1
Dil interceptors should be provided in the drainage system downstream of any significant oil and grease sources. They should be regularly maintained to prevent the release of oil and grease into the storm water drainage system after accidental spillage. The inceptor should have a bypass to prevent flooding during periods of heavy rain, as specified in <i>ProPECC PN</i>	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	N/A
Construction and Demolition Phases - General Construction and Demolition Activities All the solid waste and chemical waste generated on site should be collected, handled and disposed of properly to avoid affecting the water quality of the nearby WSRs. The proper waste management measures are detailed in S.7.7.5-S.7.7.6.	Project site / construction and demolition stages	Contractor	Construction and Demolition stage	ProPECC PN 1/94	1
Construction and Demolition Phases - Sewage Generated from On-sile Workforce	Project site / construction and	Contractor	Construction and Demolition stage	ProPECC PN 1/94	1

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
The sewage from construction work force is expected to be handled by portable chemical toilets if the existing toilets in the Project site are not adequate. Appropriate and adequate portable toilets should be provided by licensed contractors who will be responsible for appropriate disposal and maintenance of these facilities.	demolition stages				
Construction and Demolition Phases - Soil Remediation Activities Mitigation measures will need to be implemented during the currently identified soil remediation activities. If further land contamination investigation results (at CLP secondary substation during Phase I and at locations S1 to S6 during Phase II) confirm the needs for further soil remediation prior to demolition of the Existing Crematorium, relevant water quality mitigation measures (in addition to the current RAP) will need to be identified and implemented by the contractor. In addition, the mitigation measures recommended for minimizing water quality impacts for construction and demolition run-off and drainage as well as for general construction and demolition activities should also be adopted where applicable. In order to avoid impacts on water quality during further remedial works, care will be taken to minimise the mobilisation of sediment during excavation and transport. Measures to be adopted will be based on the recommendations set out in Practice Note for Professional Persons ProPECC PN194 "Construction Site Drainage". The results of the site Investigation suggest that there is unlikely to be any requirement for dewatering of		Contractor	Construction and Demolition stage	ProPECC PN 1/94	*

Recommended Mitigation Measures	Location and Timing	Who to Implement?	When to Implement?	What Requirements or Standards to Achieve?	Status
excavations, since groundwater was not encountered in any of the exploratory holes. The contractor carrying out the remedial works will be required to submit a method statement detailing the measures to be taken to avoid water quality impacts. Typical measures would include:  □ Carry out the works during the dry season (i.e. October to March) if possible  □ Use bunds or perimeter drains to prevent run-off water entering excavations  □ Sheet or otherwise cover excavations whenever rainstorms are expected to occur  □ Minimise the requirements for stockpiling of material and ensure any stockpiles are covered  □ Temporary on-site stockpiling of contaminated materials should be avoided, all excavated contaminated soils/materials should be disposed of on a daily basis  □ Ensure that any discharges to storm drains pass through an appropriate silt trap					

Note: √ × • N/A Compliance of mitigation measure Non-compliance of mitigation measures Non-compliance but rectified by the contractor Not applicable

APPENDIX K EVENT AND ACTION PLANS

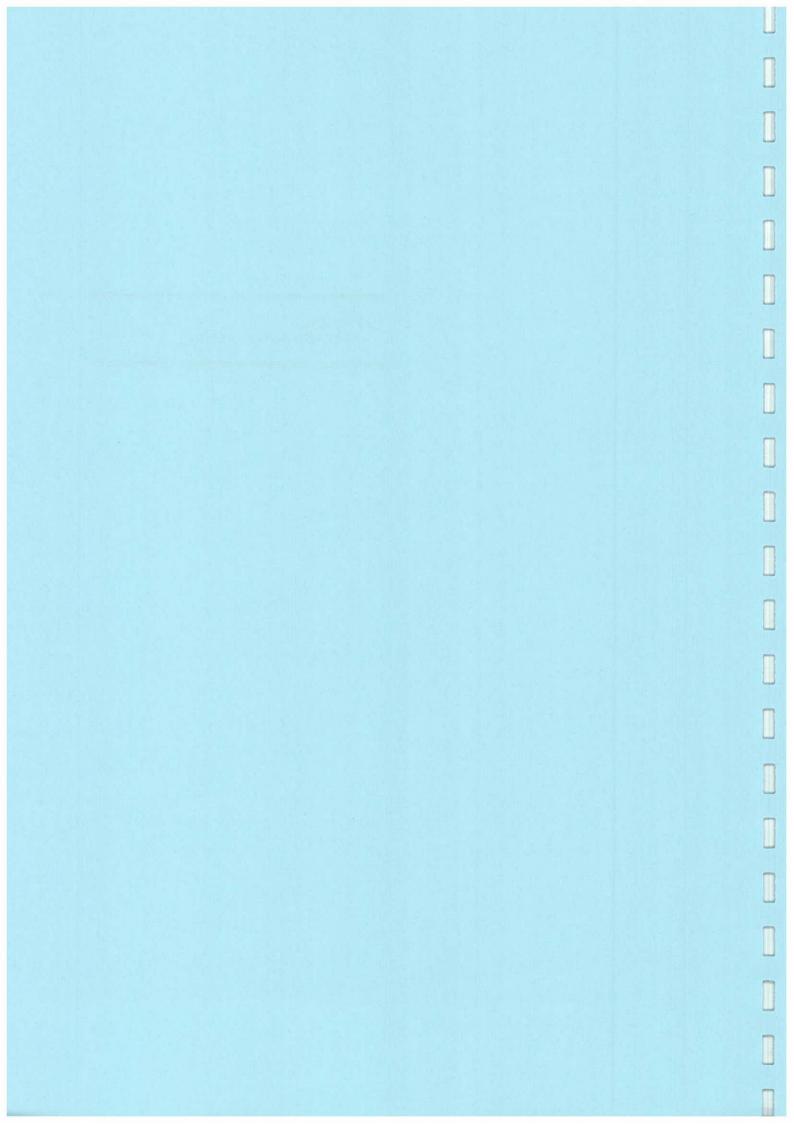

Appendix K Event and Action Plans

Table K.1 Event and Action Plan for Air Quality

		ACTION		
EVENT	ET	EC	AR	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	Identity source, investigate the cause of exceedance and propose remedial measures;     Inform IEC and AR;     Repeat measurement to confirm finding;     Increase monitoring frequency to daily, if ET assessment Indicates that exceedance is due to contractor's construction works.	Check monitoring data submitted by ET;     Check Contractor's working method.	Notify Contractor.	Recilfy any unacceptable     practice;     Amend working methods if     appropriate.
2. Exceedance for two or more consecutive samples	1. Identify source, investigate the cause of axceedance and propose remedial measures; Inform IEC and AR; 2. Repeat measurements to confirm findings; 4. Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to confractor's construction works; 5. Discuss with IEC and Contractor on remedial actions required; 6. If exceedance continues, arrange meeting with IEC and AR; 7. If exceedance stops, cease additional monitoring.	Check monitoring data submitted by ET;     Check Contractor's working method;     Discuss with ET and Contractor on possible remedial measures;     Advise the AR on the effectiveness of the proposed remedial measures;     Supenvise implementation of remedial measures.	Confirm receipt of notification of exceedance in writing:     Notify Contractor:     Ensure remedial measures properly implemented.	Submit proposals for remedial actions to IEC within three working days of notification;     Implement the agreed proposals;     Amend proposal if appropriate.
LIMIT LEVEL				
Exceedance for one sample	1. Identify source, investigate the cause of exceedance and propose remedial measures; 2. Inform IEC, AR and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily, if ET assessment indicates that exceedance is due to contractor's construction works; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD Informed of the results.	Check monitoring data submitted by ET;     Check Contractor's working method;     Discuss with ET and Contractor on possible remedial measures;     Advise the AR on the effectiveness of the proposed remedial measures;     Supposed remedial measures;     Supposed remedial measures;	Confirm receipt of notification of exceedance in writing;     Notify Contractor;     Ensure remedial measures properly implemented.	Take immediate action to avoid further exceedance;     Submit proposals for remedial actions to IEC within three working days of notification;     Implement the agreed proposals;     Amend proposal if appropriate.
2. Exceedance for two or more consecutive samples	Notlify Contractor, IEC, AR and EPD;     Identily source, investigate the cause of exceedance and propose remedial measures;     Repeat measurement to confirm findings;     Increase monitoring frequency to daily, if ET.	Discuss amongst AR, ET, and Contractor on the potential remedial actions;     Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly;	Confirm receipt of notification of exceedance in writing;     Notify Contractor;     in consultation with the IEC, agree with the Contractor on the remedial	Take immediate action to avoid further exceedance;     Submit proposals for remedial actions to IEC within three working days of notification;

	ACTION		
 ET	IEC	AR	CONTRACTOR
assessment Indicates that exceedance is due to	<ol><li>Supervise the implementation of remedial</li></ol>	measures to be implemented;	<ol><li>Implement the agreed</li></ol>
contractor's construction works;	measures.	4. Ensure remedial measures properly	proposals;
5. Carry out analysis of Contractor's working		implemented;	<ol> <li>Resubmit proposals if problem</li> </ol>
procedures to determine possible mitigation to be		5. If exceedance continues, consider	still not under control;
implemented;		what portion of the work is responsible	<ol><li>Stop the relevant portion of</li></ol>
<ol><li>Arrange meeting with IEC and AR to discuss the</li></ol>		and Instruct the Contractor to stop that	works as determined by the
remedial actions to be taken;		portion of work until the exceedance is	AR until the exceedance is
<ol><li>Assess effectiveness of Contractor's remedial</li></ol>		abated.	abated.
actions and keep IEC, AR and EPD informed of			
the results;			
<ol> <li>If exceedance stops, cease additional monitoring.</li> </ol>			

Table K.2 Event and Action Plan for Construction Noise

EVENT		ACTION		
	ET	IEC	AR	CONTRACTOR
Action Level	1. Notify Contractor and IEC; 2. Carry out investigation; 3. Report the results of investigation to the IEC and Contractor; 4. Discuss with the Contractor and formulate remedial measures; 5. Increase monitoring frequency to check mitigation effectiveness, if ET assessment indicates that exceedance is due to contractor's construction work.	Review the analysed results submitted by the ET;     Review the proposed remedial measures by the Contractor and advise the AR accordingly;     Supervise the implementation of remedial measures.	Confirm receipt of notification of exceedance in writing;     Notify Contractor;     Require Contractor to propose remedial measures for the analysed noise problem;     Ensure remedial measures are properly implemented.	Submit noise mitigation     proposals to IEC;     Implement noise     mitigation proposals.
Limit Level	1. Notify Contractor, IEC, AR and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency, if ET assessment indicates that exceedance is due to contractor's construction work; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, AR and EPD the causes and actions taken for the exceedances; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, AR and EPD informed of the results; 8. If exceedance stops, cease additional monitoring.	Discuss amongst AR, ET, and Contractor on the potential remedial actions;     Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly;     Supervise the implementation of remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the AR until the exceedance is abated.