



**CONTRACT NO: KL/2009/01**  
**SITE FORMATION FOR**  
**KAI TAK CRUISE TERMINAL DEVELOPMENT**

**QUARTERLY ENVIRONMENTAL MONITORING & AUDIT**  
**REPORT**

- SEPTEMBER TO NOVEMBER 2012 -

**CLIENT:**

**Penta-Ocean Construction Co., Ltd.**

Unit 601, K. Wah Centre,  
191 Java Road,  
North Point,  
Hong Kong

**PREPARED BY:**

**Lam Environmental Services  
Limited**

11/F Centre Point  
181-185 Gloucester Road,  
Wanchai, H.K.


Telephone: (852) 2882-3939  
Facsimile: (852) 2882-3331  
E-mail: [info@lamenviro.com](mailto:info@lamenviro.com)  
Website: <http://www.lamenviro.com>

**CERTIFIED BY:**

Raymond Dai  
Environmental Team Leader

**DATE:**

21 December 2012

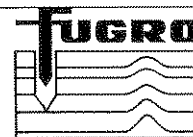

**FAX MESSAGE**

Priority  normal /  urgent

To	<u>Lam Environmental Services Limited</u>	Ref. No.	<u>MCLF3174</u>
Country		Email	<u>raymond dai@lamenviro.com</u>
Attn.	<u>Mr. Raymond Dai</u>	Date	<u>20 December 2012</u>
From	<u>Joseph Poon</u>	No. of Pages	<u>1</u> (Incl. this page)
C.c. To	<u>Mr. Brad Chan</u> <u>(Scott Wilson Limited)</u>	Email	<u>brad.chan@scottwilson.com.hk</u>
	<u>Mr. K. Y. Shin</u> <u>(Civil Engineering and Development Department)</u>	Email	<u>kyshin@cedd.gov.hk</u>
	<u>Mr. Stephen Cheng</u> <u>(Scott Wilson Limited)</u>	Email	<u>stephen.cheng@scottwilson.com.hk</u>
	<u>Mr. Andrew Tam</u> <u>(Scott Wilson Limited)</u>	Email	<u>andrew.tam@scottwilson.com.hk</u>
	<u>Mr. Perry Yam</u> <u>(Penta-Ocean Construction Company Limited)</u>	Email	<u>perry.yam@pentaocean.com.hk</u>
Subject	<b>Agreement No. CE 19/2009 (EP) Dredging Works for Proposed Cruise Terminal at Kai Tak – Quarterly Environmental Monitoring &amp; Audit Report for September 2012 to November 2012</b>		

We refer to the revised Quarterly EM&A Report for September 2012 to November 2012 that we received through email on 19 December 2012 and are pleased to confirm we have no further comment on the report.

Should you require further information, please feel free to contact us.

Best regards,

Joseph Poon  
Independent Environmental Checker

JP/CY/by

**CONFIDENTIALITY NOTICE**

This facsimile transmission is intended only for the use of the addressee and is confidential. If you are not the addressee it may be unlawful for you to read, copy, disclose or otherwise use the information in this facsimile. If you are not the intended recipient, please telephone or fax us immediately.

(If you do not receive all pages, please fax response or phone +852-24508238.)

**TABLE OF CONTENTS**

<b>EXECUTIVE SUMMARY .....</b>	<b>III</b>
<b>1. INTRODUCTION.....</b>	<b>1</b>
1.1 Scope of the Report .....	1
1.2 Structure of the Report.....	1
<b>2. PROJECT BACKGROUND.....</b>	<b>2</b>
2.1 Background .....	2
2.2 Scope of the Project and Site Description .....	2
2.3 Project Organization.....	2
2.4 Principal Work and Activities.....	3
<b>3. MONITORING REQUIREMENTS.....</b>	<b>4</b>
3.1. Noise Monitoring .....	4
3.2. Water Quality Monitoring.....	4
<b>4. MONITORING RESULTS .....</b>	<b>6</b>
4.1. Water Monitoring Results.....	6
4.2. Water Quality Surveillance System.....	7
4.3. Dredging and Disposal.....	7
<b>5. COMPLIANCE AUDIT, REVIEW OF THE REASONS FOR AND THE IMPLICATIONS OF NON-COMPLIANCE.....</b>	<b>9</b>
5.1. Noise Monitoring .....	9
5.2. Water Quality Monitoring.....	9
5.3. Water Quality against the Tidal Movement along Victoria Harbour .....	9
5.4. Natural Variation Comparison .....	10
5.5. Site Audit.....	11
5.6. Summary of action taken in the event of and follow-up on non-compliance .....	11
<b>6. COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION .....</b>	<b>12</b>
<b>7. CONCLUSION .....</b>	<b>13</b>

**LIST OF TABLES**

<b>Table I</b>	<b><i>Principle Work Activities in the Reporting Quarter</i></b>
<b>Table II</b>	<b><i>Summary of Cancellation of water quality monitoring in the Reporting Quarter</i></b>
<b>Table 2.2</b>	<b><i>Contact Details of Key Personnel</i></b>
<b>Table 2.4</b>	<b><i>Principle Work Activities during the Reporting Quarter</i></b>
<b>Table 3.1</b>	<b><i>Noise Monitoring Stations</i></b>
<b>Table 3.2</b>	<b><i>Marine Water Quality Stations for Water Quality Monitoring</i></b>
<b>Table 3.3</b>	<b><i>Water Quality Monitoring Frequency and Parameters</i></b>
<b>Table 4.1.1</b>	<b><i>Summary of Cancellation of water quality monitoring in the Reporting Quarter</i></b>
<b>Table 4.1.2</b>	<b><i>Summary of Exceedances Recorded in the Reporting Quarter</i></b>
<b>Table 4.2.1</b>	<b><i>Compliance with EP Conditions in the Reporting Quarter</i></b>
<b>Table 4.2.2</b>	<b><i>Waste Quantities Related To Dredging Works</i></b>
<b>Table 5.4</b>	<b><i>Upper Bound of Natural Variation Levels at Water Monitoring Stations</i></b>
<b>Table 6.1</b>	<b><i>Environmental Complaints Log</i></b>
<b>Table 6.2</b>	<b><i>Cumulative Statistics on Complaints</i></b>
<b>Table 6.3</b>	<b><i>Cumulative Statistics on Successful Prosecutions</i></b>

**LIST OF FIGURES**

<b><u>Figure 2.1</u></b>	<b><i>General Layout</i></b>
<b><u>Figure 2.2</u></b>	<b><i>Project Organization Chart</i></b>
<b><u>Figure 3.1</u></b>	<b><i>Layout of Environmental Monitoring Stations</i></b>
<b><u>Figure 4.1</u></b>	<b><i>Layout of Monitoring Stations for Water Quality Surveillance System</i></b>

**LIST OF APPENDICES**

<b><u>Appendix 2.1</u></b>	<b><i>Implementation Schedule of Environmental Mitigation Measures</i></b>
<b><u>Appendix 3.1</u></b>	<b><i>Action and Limit Levels</i></b>
<b><u>Appendix 4.1</u></b>	<b><i>Graphical Presentation of Water Quality Monitoring Results</i></b>
<b><u>Appendix 4.2</u></b>	<b><i>Graphical Presentation of Water Quality Surveillance System</i></b>
<b><u>Appendix 5.1</u></b>	<b><i>Event and Action Plan</i></b>
<b><u>Appendix 5.2</u></b>	<b><i>Graphic Presentation of SS Results against to Tidal Movement along Victoria Harbour</i></b>
<b><u>Appendix 5.3</u></b>	<b><i>Graphic Presentation of Water Quality Result with respect to Local Variation</i></b>
<b><u>Appendix 7.1</u></b>	<b><i>Construction Programme</i></b>



**EXECUTIVE SUMMARY**

- i. This is the **tenth** Quarterly Environmental Monitoring and Audit (EM&A) Report – **September to November 2012** for the Site Formation for Kai Tak Cruise Terminal Development under Contract No. KL/2009/01. Dredging of marine sediment has been commenced since 28 June 2010 while removal and reconstruction of existing seawall has been commenced since 22 November 2010. This report presents the environmental monitoring findings and information recorded during the period from **September to November 2012**.

Construction Activities in the Reported Period

- ii. During the reporting period, the principle work activities are summarized as below:

**Table I Principle Work Activities in the Reporting Quarter**

September 2012	October 2012	November 2012
<ul style="list-style-type: none"> <li>• Dredging of Marine Sediment;</li> <li>• Removal of Existing Seawall;</li> <li>• Fabrication and installation of silt curtain for seawall removal;</li> <li>• Maintenance of Silt Curtain and Silt Screens;</li> <li>• Sorting of inert C&amp;D material from existing seawall;</li> <li>• Disposal of surplus fill material off-site; and</li> <li>• Reconstruction of New Seawall</li> </ul>	<ul style="list-style-type: none"> <li>• Dredging of marine sediment;</li> <li>• Removal of Existing Seawall;</li> <li>• Fabrication and installation of silt curtain for seawall removal;</li> <li>• Maintenance of Silt Curtain and Silt Screens;</li> <li>• Sorting of inert C&amp;D material from existing seawall;</li> <li>• Disposal of surplus fill material off-site; and</li> <li>• Reconstruction of New Seawall</li> </ul>	<ul style="list-style-type: none"> <li>• Dredging of Marine Sediment;</li> <li>• Removal of Existing Seawall;</li> <li>• Fabrication and installation of silt curtain for seawall removal;</li> <li>• Maintenance of Silt Curtain and Silt Screens;</li> <li>• Sorting of inert C&amp;D material from existing seawall;</li> <li>• Disposal of surplus fill material off-site; and</li> <li>• Reconstruction of New Seawall</li> </ul>

Noise Monitoring

- iii. Due to the non-existence of planned NSRs during the reporting quarter, no noise monitoring was required to be conducted at the planned noise monitoring locations NM1 and NM2.

Water Quality Monitoring

- iv. Due to adverse weather conditions (i.e. hoisting of Amber Rainstorm Warnings and Strong Wind Signal No. 3 or above), the following water quality monitoring were cancelled.

**Table II Summary of Cancellation of water quality monitoring in the Reporting Quarter**

Date	Tide	Reason for Cancellation
24-Sep-2012	Mid-Flood	Hoisting of Amber Rainstorm Warning

- v. Water quality monitoring was conducted at 6 designated monitoring stations namely WSD9, WSD10, WSD15, WSD17, WSD19 and WSD21. Turbidity exceedances were found on the 5 September 2012 at WSD10 during ebb tide; 28 September 2012 at WSD10 during flood tide; 02 October 2012 at WSD9 during flood tide, WSD10 during flood and ebb tide, WSD15 during ebb tide and WSD19 during ebb tide; 04 October 2012 at WSD15 during flood tide and WSD17 during flood tide; 17 October 2012 at WSD9 during flood tide, WSD15 during flood tide and WSD19 during flood tide; 20 October 2012 at WSD9 during flood and ebb tide, WSD17 during flood tide; 22 October 2012 at WSD10 during flood tide and WSD15 during

- ebb tide; 29 October 2012 at WSD9 during flood tide and WSD15 during flood tide; 31 October 2012 at WSD9 during flood and ebb tide and WSD17 during flood tide; 2 November 2012 at WSD10 during flood tide, 3 November 2012 at WSD10 during ebb tide, 12 November 2012 at WSD17 during flood tide; 14 Nov 2012 at WSD9 during flood tide, 29 November 2012 at WSD9 during ebb tide. SS exceedances were found on the 10 September 2012 at WSD10 during ebb tide; 28 September 2012 at WSD17 during flood tide; 2 October 2012 at WSD10 during ebb tide, WSD15 during ebb tide, WSD17 during ebb tide and WSD19 during ebb tide; 4 October 2012 at WSD15 during flood tide and WSD17 during flood tide; 13 October 2012 at WSD15 during flood tide and WSD17 during flood tide; 15 October 2012 at WSD15 during flood tide; 17 October 2012 at WSD15 during flood tide; 20 October 2012 at WSD10 during flood tide and WSD17 during flood tide; 22 October 2012 at WSD10 during flood tide, WSD15 during flood tide and WSD19 during flood tide; 27 October 2012 at WSD10 during flood tide; 29 October 2012 at WSD15 during flood tide; 31 October 2012 at WSD10 during flood and ebb tide, WSD15 during flood tide, WSD17 during flood tide and WSD19 during ebb tide; 2 Nov 2012 at WSD10 during flood tide; 8 Nov 2012 at WSD10 during flood tide; 10 Nov 2012 at WSD21 during ebb tide and WSD 10 during flood tide; 12 Nov 2012 at WSD17 during flood tide; 17 Nov 2012 at WSD17 during flood tide. Investigations found that all exceedances were not related to the Project works.
- vi. Supplementary to Baseline Water Quality Monitoring Report – Review of Action and Limit Levels (Revision 1.2) was submitted to EPD on 13 October 2011. With respect to the EPD's no comment on the new Action and Limit Levels for water monitoring on 19 October 2011, the new set Action and Limit Levels for turbidity and SS was started to use from 19 October 2011.
- Water Quality against the Tidal Movement along Victoria Harbour
- vii. In the recorded exceedance(SS & turbidity), **twelve turbidity exceedance and six SS exceedance** were the downstream stations from project location, no rising of SS level at other downstream stations. It is concluded that no water quality impact was arising from the Project works.
- viii. In the recorded exceedance(SS & Turbidity), **fifteen turbidity exceedance and twenty-four SS exceedance** were upstream from project location, no rising of turbidity was observed at downstream stations. It is concluded that no water quality impact was arising from the Project works.
- Natural Variation Comparison
- ix. Based on the determination of upper bound of the natural variation levels from the Supplementary to Baseline Water Quality Monitoring Report, most SS results in reporting period were well within the upper bound of natural variation levels.
- x. For the SS exceedance recorded on 10 Sep 2012 at WSD10 (Mid-ebb) revealed that no rising of SS level at other downstream stations of WSD17 and WSD15. The rise in SS level might have been caused by localized impact from nearby transferral of filling materials activities or changes around the monitoring station. It is concluded that no adverse water quality impact was arising from the Project works.

- xi. For the SS exceedance recorded on 2 Oct 2012 at WSD10 (Mid-ebb), WSD15 (Mid-ebb) and WSD17(Mid-ebb) revealed that no apparent rise of SS after passing the project site. The rise in SS level might be caused by accumulation of filling materials from nearby transferral of filling materials activities or changes at upstream, as relatively SS concentration were recorded at WSD19, the furthest upstream station.
- xii. For the SS exceedance recorded on 22 Oct 2012 at WSD19 (Mid-flood) revealed that no apparent rise of SS after passing the project site. The rise in SS level might be caused by accumulation of filling materials from nearby transferral of filling materials activities or changes at upstream, as relatively SS concentration were recorded at WSD10 and WSD15, the furthest upstream station.
- xiii. For the SS exceedance recorded on 31 Oct 2012, WSD10 (Mid-ebb) revealed that no apparent rise of SS after passing the project site. The rise in SS level might be caused by accumulation of filling materials from nearby transferral of filling materials activities or changes at upstream, as relatively SS concentration were recorded at WSD19, the furthest upstream station. It definitely concluded that the exceedance was not related to the Project works.
- xiv. For the SS exceedance recorded on 28 Sep 2012 of WSD17 (Mid-flood), 2 Oct 2012 of WSD19 (Mid-ebb), 4 Oct 2012, 13 Oct 2012, 15 Oct 2012, 17 Oct 2012, 20 Oct 2012, 22 Oct 2012 of WSD10 and WSD15, 27 Oct 2012, 29 Oct 2012, 31 Oct 2012 of WSD10 (Mid-flood), WSD15 (Mid-flood), WSD17 (Mid-flood) and WSD19 (Mid-ebb), 2 Nov 2012, 8 Nov 2012, 10 Nov 2012, 12 Nov 2012, 17 Nov 2012 were upstream from project location, no rising of SS was observed at downstream stations.
- xv. It definitely concluded that the exceedances were not related to the Project works.

#### Water Quality Surveillance System

- xvi. With reference to the upper bound of natural variation levels and water quality surveillance conducting in reporting period, most monitoring stations downstream of project were well within the action level and hence this further supports such exceedances are not caused by dredging activities.
- xvii. Since the investigations found that the exceedances recorded in the reporting quarter were not related to the Project, it was concluded that all necessary steps under Event and Action Plan had been taken. The details of Event and Action Plans and Notification of Exceedance summarizing the finding of investigation, possible causes can be referred to the Monthly EM&A Reports.

#### Waste Management

- xviii. In this reporting quarter, there was marine sediment (Type 1 – Open Sea Disposal) disposed to South Cheung Chau Spoil Disposal Area denoted “KTCT-1” and “KTCT -2”. The dredging and disposal of the sediment (Type 1 – Open Sea Disposal (Dedicate Sites) and Type 2 – Confined Marine Disposal) to East Sha Chau Contaminated Mud Disposal Site – Pit IVc was completed in June 2011.



- xix. There were 17,000m<sup>3</sup> inert surplus fill materials and 70m<sup>3</sup> non-inert C&D material related to dredging works were disposed off site in this reporting quarter.

Complaints, Notifications of Summons and Successful Prosecutions

- xx. No complaint, notification of prosecutions or summons was received in the reporting quarter.

## 1. INTRODUCTION

### 1.1 Scope of the Report

1.1.1. Lam Environmental Services Limited (LES) has been appointed to work as the Environmental Team (ET) for dredging works to implement the Environmental Monitoring and Audit (EM&A) programme for the Site Formation for Kai Tak Cruise Terminal Development under Contract No. KL/2009/01. Dredging of marine sediment and removal and reconstruction of existing seawall were commenced on 28 June and 22 November 2010 respectively.

1.1.2. This report presents the environmental monitoring and auditing work carried out in accordance to the Section 10.7 under Environmental Monitoring and Audit (EM&A) Manual.

1.1.3. This report documents the finding of EM&A works during the quarter from [September to November 2012](#).

### 1.2 Structure of the Report

**Section 1**      *Introduction* – details the scope and structure of the report.

**Section 2**      *Project Background* – summarizes background and scope of the Project, site description, project organization and contact details of key personnel during the reporting period.

**Section 3**      *Monitoring Requirements* – summarizes all monitoring parameters, monitoring locations, monitoring frequency, duration and action plan.

**Section 4**      *Monitoring Results* – summarizes the monitoring results obtained in the reporting period.

**Section 5**      *Compliance Audit, Review of the Reasons for and the Implication of Non-compliance* – summarizes the auditing of monitoring results, all exceedances environmental parameters, review the reasons for and the implication of non-compliance.

**Section 6**      *Complaints, Notification of summons and Prosecution* – summarizes the cumulative statistics on complaints, notification of summons and prosecution

**Section 7**      *Conclusion*

## 2. PROJECT BACKGROUND

### 2.1 Background

- 2.1.1. The former Kai Tak Airport located in the south-eastern part of Kowloon Peninsula was the international airport of Hong Kong. The Kai Tak Airport had come into operations since 1920s. The operation of the Kai Tak Airport was ceased and replaced by the new airport at Chek Lap Kok in July 1998. After closure, the disused airport site has been occupied by various temporary uses, including a golf driving range on the runway area.
- 2.1.2. In 2002, the Chief Executive in Council approved the Kai Tak Outline Zoning Plans (No. S/K19/3 and S/K21/3) to provide the statutory framework to proceed with the South East Kowloon Development at the former Kai Tak Airport. However, following the judgment of the Court of Final Appeal in January 2004 regarding the Harbour reclamation, the originally proposed development which involves reclamation has to be reviewed. The Kai Tak Planning Review (KTPR) has resulted with a Preliminary Outline Development Plan (PODP) for Kai Tak in October 2006. Subsequently, the Administration announced in October 2006 a plan to implement a cruise terminal at Kai Tak, as part of the development.
- 2.1.3. Development of the cruise terminal at Kai Tak would require dredging at the existing seawall at the southern tip of the former Kai Tak Airport runway for construction of a quay deck structure for two berths, and dredging the seabed fronting the new quay to provide necessary manoeuvring basin. The general layout of the proposed cruise terminal construction is shown in **Figure 2.1**.
- 2.1.4. The current Project involves a dredging operation exceeding 500,000m<sup>3</sup> for construction and operation of the proposed cruise terminal at Kai Tak and is therefore classified as a Designated Project under Item C.12, Part I, Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO). An Environmental Impact Assessment (EIA) Study for the Project has been undertaken in accordance with the EIA Study Brief (No. ESB-159/2006) and the Technical Memorandum on Environmental Impact Assessment Process (EIAO-TM).

### 2.2 Scope of the Project and Site Description

- 2.2.1. The scope of the Project comprises:
- Dredging of marine sediment of about 700,000m<sup>3</sup> from the existing seabed (Stage 1 dredging) in the Harbour area off the southern tip of the former Kai Tak Airport runway to provide the necessary water depth within the manoeuvring area for cruise vessels; and
  - Removal of existing seawall of about 322,300m<sup>3</sup> by dredging at the southern tip of the former Kai Tak Airport runway for cruise berth construction.

### 2.3 Project Organization

- 2.3.1. Kowloon Development Office of Civil Engineering and Development Department is the overall project controller. For the construction phase of the Project, Project Engineer, Contractor,

Environmental Team and Independent Environmental Checker are appointed to manage and control environmental issues.

2.3.2. The proposed project organization and lines of communication with respect to environmental protection works are shown in **Figure 2.2**. Key personnel and contact particulars are summarized in **Table 2.2**:

**Table 2.2 Contact Details of Key Personnel**

Party	Role	Name	Post	Contact No.	Contact Fax
Civil Engineering and Development Department (Kowloon Development Office)	Project Proponent	Ir. KY Shin	Senior Engineer	2301 1461	2301 1277
URS / Scott Wilson Limited	Engineer's Representative	Mr. Stephen Cheng	Chief Resident Engineer	2148 7638	2148 7277
Penta-Ocean Construction Company Limited	Contractor	Mr. H. Taguchi	Project Manager	2148 7238	2148 7138
		Mr. K. Takae	Site Agent		
		Mr. Perry Yam	Environmental Officer		
Fugro (HK) Limited	Independent Environmental Checker (IEC)	Mr. Joseph Poon	Independent Environmental Checker (IEC)	2450 8238	2450 6138
Lam Environmental Services Limited	Environmental Team Leader	Mr. Raymond Dai	Environmental Team Leader (ETL)	2882 3939	2882 3331

## 2.4 Principal Work and Activities

2.4.1. During this reporting quarter, the principal work activities are summarized in **Table 2.4**.

**Table 2.4 Principle Work Activities during the Reporting Quarter**

September 2012	October 2012	November 2012
<ul style="list-style-type: none"> <li>• Dredging of marine sediment;</li> <li>• Removal of Existing Seawall;</li> <li>• Fabrication and installation of silt curtain for seawall removal;</li> <li>• Maintenance of Silt Curtain and Silt Screens;</li> <li>• Sorting of inert C&amp;D material from existing seawall;</li> <li>• Disposal of surplus fill material off-site; and</li> <li>• Reconstruction of New Seawall</li> </ul>	<ul style="list-style-type: none"> <li>• Dredging of marine sediment;</li> <li>• Removal of Existing Seawall;</li> <li>• Fabrication and installation of silt curtain for seawall removal;</li> <li>• Maintenance of Silt Curtain and Silt Screens;</li> <li>• Sorting of inert C&amp;D material from existing seawall;</li> <li>• Disposal of surplus fill material off-site; and</li> <li>• Reconstruction of New Seawall</li> </ul>	<ul style="list-style-type: none"> <li>• Dredging of Marine Sediment;</li> <li>• Removal of Existing Seawall;</li> <li>• Fabrication and installation of silt curtain for seawall removal;</li> <li>• Maintenance of Silt Curtain and Silt Screens;</li> <li>• Sorting of inert C&amp;D material from existing seawall;</li> <li>• Disposal of surplus fill material off-site; and</li> <li>• Reconstruction of New Seawall</li> </ul>

2.4.2. Implementation status of the recommended mitigation measures during this reporting period is presented in **Appendix 2.1**.

### 3. MONITORING REQUIREMENTS

#### 3.1. Noise Monitoring

- 3.1.1. In accordance with the EIA Report and the approved EM&A Manual, it is anticipated that construction activities, if unmitigated, would not cause any adverse noise impact to the nearest NSRs in the vicinity of the work site. The predicted noise levels at the NSRs would comply with construction noise criteria. These nearest NSRs are designated for construction noise monitoring as listed in **Table 3.1**.

**Table 3.1 Noise Monitoring Stations**

Station	Description
NM1	Planned Residential Development (R3 site)
NM2	Planned Residential Development (R3 site)

- 3.1.2. As per S.3.1.1 of the approved EM&A Manual states that "Noise levels shall be monitored to evaluate the construction noise impact if there is any planned noise sensitive receivers (NSRs) occupied within 300m from the works area of this Project during the proposed dredging works". Therefore, the impact monitoring for construction noise shall only be carried out when the planned residential development at the two identified monitoring stations are occupied at a later stage.

#### 3.2. Water Quality Monitoring

- 3.2.1. The EIA Report has identified that suspended solids (SS) would be the most critical water quality parameter during the dredging operations. Water quality monitoring for SS and turbidity is therefore recommended to be carried out at selected WSD flushing water intakes. The impact monitoring should be carried out during the proposed dredging works for cruise terminal construction to ensure the compliance with the water quality standards.

- 3.2.2. It is proposed to monitor the water quality at six WSD flushing water intakes along the seafront of the Victoria Harbour. The proposed water quality monitoring stations are shown in **Table 3.2** and **Figure 3.1**.

**Table 3.2 Marine Water Quality Stations for Water Quality Monitoring**

Station Ref.	WSD Flushing Water Intake	Easting	Northing
WSD9	Tai Wan	837921.0	818330.0
WSD10	Cha Kwo Ling	841900.9	817700.1
WSD15	Sai Wan Ho	841110.4	816450.1
WSD17	Quarry Bay	839790.3	817032.2
WSD21	Wan Chai	836220.8	815940.1
WSD19	Sheung Wan	833415.0	816771.0



WATER QUALITY PARAMETERS AND FREQUENCY

- 3.2.3. During the period of dredging, monitoring should be undertaken three days per week, at mid-flood and mid-ebb tides, with sampling / measurement at the designated monitoring stations as shown in **Table 3.2**. The interval between two sets of monitoring should not be less than 36 hours except where there are exceedances of Action and/or Limit Levels, in which case the monitoring frequency will be increased. **Table 3.3** shows the proposed monitoring frequency and water quality parameters. Duplicate in-situ measurements and water sampling should be carried out in each sampling event. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides should not be less than 0.5m.
- 3.2.4. Silt screens in frame type or floating type shall be deployed at these intakes during the dredging period. It is recommended to conduct the monitoring behind the silt screens at the seawater intake culvert at each seawater pumping station to collect information on the water quality condition after passed the silt screen.

**Table 3.3 Water Quality Monitoring Frequency and Parameters**

Activities	Monitoring Frequency <sup>1</sup>	Parameters <sup>2</sup>
During the 4-week baseline monitoring period	Three days per week, at mid-flood and mid-ebb tides	Turbidity (in NTU), Suspended Solids (SS in mg/L)
During dredging works for proposed cruise terminal at Kai Tak	Three days per week, at mid-flood and mid-ebb tides	Turbidity (in NTU), Suspended Solids (SS in mg/L)

Notes:

1. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides should be not less than 0.5m.
2. Turbidity should be measured in situ whereas SS should be determined by laboratory.

- 3.2.5. [Supplementary to Baseline Water Quality Monitoring Report – Review of Action and Limit Levels \(Revision 1.2\)](#) was submitted to EPD on 13 October 2011. With respect to the EPD's no comment on the new Action and Limit Levels for water monitoring on 19 October 2011, the new set Action and Limit Levels for turbidity and SS was started to use from 19 October 2011. The established Action and Limit levels can be referred to [Appendix 3.1](#).

#### 4. MONITORING RESULTS

##### 4.1. Water Monitoring Results

4.1.1. A summary of the cancellation of water quality monitoring is presented in **Table 4.1.1**.

**Table 4.1.1 Summary of Cancellation of water quality monitoring in the Reporting Quarter**

Date	Tide	Reason for Cancellation
24-Sep-2012	Mid-Flood	Hoisting of Amber Rainstorm Warning

4.1.2. The water quality monitoring was commenced concurrently with the commencement of dredging works on 28 June 2010. Water quality monitoring was conducted at 6 designated monitoring stations namely WSD9, WSD10, WSD15, WSD17, WSD19 and WSD21 during the reporting quarter.

4.1.3. Water monitoring results measured in this reporting period are reviewed and summarized. Details of graphical presentation can be referred in **Appendix 4.1**. The details of exceedances are summarized in **Table 4.1.2**.

**Table 4.1.2 Summary of Exceedances Recorded in the Reporting Quarter**

Period		Level	WSD9		WSD10		WSD15		WSD17		WSD19		WSD21	
			Turb	SS	Turb	SS	Turb	SS	Turb	SS	Turb	SS	Turb	SS
			NTU	mg/L	NTU	mg/L	NTU	mg/L	NTU	mg/L	NTU	mg/L	NTU	mg/L
Mid-flood	Sep-12	AL	0	0	1	0	0	0	0	1	0	0	0	0
	Oct-12		5	0	2	0	3	2	2	1	1	0	0	0
	Nov-12		1	0	1	0	0	0	1	1	0	0	0	0
Mid-ebb	Sep-12	AL	0	0	1	0	0	0	0	0	0	0	0	0
	Oct-12		2	0	1	1	2	1	0	1	1	1	0	0
	Nov-12		1	0	1	0	0	0	0	0	0	0	0	0
<b>Total of AL Exceedances:</b>			<b>9</b>	<b>0</b>	<b>7</b>	<b>1</b>	<b>5</b>	<b>3</b>	<b>3</b>	<b>4</b>	<b>2</b>	<b>1</b>	<b>0</b>	<b>0</b>
Mid-flood	Sep-12	LL	0	0	0	0	0	0	0	0	0	0	0	0
	Oct-12		0	0	0	4	0	5	1	3	0	1	0	0
	Nov-12		0	0	0	3	0	0	0	1	0	0	0	0
Mid-ebb	Sep-12	LL	0	0	0	1	0	0	0	0	0	0	0	0
	Oct-12		0	0	0	1	0	0	0	0	0	1	0	0
	Nov-12		0	0	0	0	0	0	0	0	0	0	0	1
<b>Total of LL Exceedances:</b>			<b>0</b>	<b>0</b>	<b>0</b>	<b>9</b>	<b>0</b>	<b>5</b>	<b>1</b>	<b>4</b>	<b>0</b>	<b>2</b>	<b>0</b>	<b>1</b>
<b>Total of Exceedances:</b>			<b>9</b>		<b>17</b>		<b>13</b>		<b>12</b>		<b>5</b>		<b>1</b>	

5

4.1.4. Total 27 turbidity and 30 SS exceedances were recorded in the reporting period. Investigation found that the exceedances were located at the upstream station of the Project site or due to localized impact and were not due to the Project work. It concluded that no adverse water quality impact was arising from the Project works. Details of investigations can be referred in Section 5.

**4.2. Water Quality Surveillance System**

4.2.1. Six self water quality surveillance monitoring events for removal of existing seawall were conducted in the reporting period. Turbidity and SS monitoring were conducted at 12 locations as follows and shown in **Figure 4.1**.

- One sampling point inside the silt curtain (SP1);
- Four sampling points outside the silt curtain (MP1-MP4);
- Seven control points (C1-C7)

4.2.2. The graphical presentation of the SS levels at SP1, sampling points outside the silt curtain, control points and impact water quality monitoring stations against the distance are shown in **Appendix 4.2**.

**4.3. Dredging and Disposal**

4.3.1. Implementation of mitigation measures for dredging work and the associated dredging records were checked and the findings are summarized in **Table 4.2.1**.

**Table 4.2.1 Compliance with EP Conditions in the Reporting Quarter**

EP Condition	Compliance Status and/or Recommendation
2.6 Silt Curtain Deployment	In accordance with the EP requirement
2.6 For removal of the existing seawall and the seabed, Daily Dredging Rate $\leq 4,000\text{m}^3/\text{d}$ Hourly Dredging Rate $\leq 334\text{m}^3/\text{hr}$	Complied with the EP requirement in reporting quarter: Maximum daily Dredging Rate was at $600\text{m}^3/\text{day}$ and Maximum hourly Dredging Rate was at $100\text{m}^3/\text{hr}$ .
2.7 Daily Dredging Rate $\leq 4,000\text{m}^3/\text{d}$ Hourly Dredging Rate $\leq 334\text{m}^3/\text{hr}$	Complied with the EP requirement in reporting month: Maximum daily Dredging Rate was at $3,591\text{m}^3/\text{day}$ and Maximum hourly Dredging Rate was at $324\text{m}^3/\text{hr}$ .
2.8 Silt Screen Deployment	In accordance with the Silt Screen Deployment Plan for all 6 intakes

4.3.2. The daily and hourly dredging rates were checked and reviewed that were below the EP requirements. It was concluded that the dredging was conducted in compliance with the specific EP requirements.

4.3.3. The dredging and disposal of the sediment (Type 1 – Open Sea Disposal (Dedicate Sites) and Type 2 – Confined Marine Disposal) to East Sha Chau Contaminated Mud Disposal Site – Pit IVc was completed.

4.3.4. There were  $17,000\text{m}^3$  inert surplus fill materials and  $70\text{m}^3$  non-inert C&D material related to dredging works were disposed off site in this reporting quarter.

4.3.5. Details of the marine sediment dumping are summarized in **Table 4.2.2**.

**Table 4.2.2 Waste Quantities Related To Dredging Works**

Waste Type	Quantity this quarter, m <sup>3</sup> , (Bulk Volume)	Cumulative Quantity-to-Date, m <sup>3</sup> , (Bulk Volume)	Disposal / Dumping Grounds
Marine Sediment (Type 1 – Open Sea Disposal)	102,941	527,522	South Cheung Chau Spoil Disposal Area denoted “KTCT-1” and “KTCT -2”
Marine Sediment (Type 1 – Open Sea Disposal (Dedicated Sites) & Type 2 – Confined Marine Disposal) *	NIL	Completed	East Sha Chau Contaminated Mud Disposal Site – Pit IVc

\* Remarks: The disposal of marine sediment (Type 1 – Open Sea Disposal (Dedicated Sites) and Type 2 – Confined Marine Disposal) was completed.

## 5. COMPLIANCE AUDIT, REVIEW OF THE REASONS FOR AND THE IMPLICATIONS OF NON-COMPLIANCE

5.0.1. The Event Action Plan for construction noise and water quality is presented in [Appendix 5.1](#).

### 5.1. Noise Monitoring

5.1.1. Noise monitoring was not necessary in the reporting period due to non-presence of NSR.

### 5.2. Water Quality Monitoring

5.2.1. For the suspended solid, the details of exceedance in the reporting period are as follows:

- 1 Action Level and 9 Limit Level SS exceedances were recorded at WSD10
- 3 Action Level and 5 Limit Level SS exceedances were recorded at WSD15
- 4 Action Level and 4 Limit Level SS exceedances were recorded at WSD17
- 1 Action Level and 2 Limit Level SS exceedances were recorded at WSD19
- 1 Limit Level SS exceedances was recorded at WSD21

5.2.2. Total 30 SS exceedances were recorded in the reporting period. Silt curtain and silt screens were checked and confirmed in proper condition during the water monitoring. [Investigations found that the exceedances were not related to the Project works.](#)

5.2.3. For the exceedances, further investigations were conducted to determine the cause of impact in terms of the following areas:

- Water Quality against the Tidal Movement along Victoria Harbour;
- Natural Variation Comparison; and
- Water Quality Surveillance System

5.2.4. More details on the investigation are given in Section 5.3 to 5.5.

### 5.3. Water Quality against the Tidal Movement along Victoria Harbour

5.3.1. In order to conclude the cause of an adverse water quality impact, the trend across the 6 monitoring stations is reviewed. Whether the adverse impact is due to project work will be evaluated from the trend of SS level in downstream across the Victoria Harbour after passing the project location. By observing this trend of SS, contribution of the adverse water quality impact from the dredging activities under the project can be evaluated by checking if there is a significant rising up trend in the SS level in the WSD intakes at project downstream.

5.3.2. Moreover, a comparison of the monitoring station at project downstream stations with the upstream monitoring stations can also indicate whether the extent of exceedance in SS content recorded at the WSD intakes downstream to the project is likely to be caused by upstream source or not. If the SS values of the upstream and downstream show similar levels, the impact at the project downstream stations shall probably be due to the project upstream streams and the contribution from project work can be eliminated. A review on the tidal movement across the Victoria Harbour is plotted against the SS results and graphical presentation is presented in [Appendix 5.2](#).

5.3.3. Investigations on the recorded upstream exceedances revealed that there were no significant rising up trend of SS levels across the Victoria Harbour after passing the project location. For the downstream exceedances, no rising of SS at other downstream stations were recorded, and were due to localized impact. It is concluded that no adverse water quality impact was arising from the Project works.

**5.4. Natural Variation Comparison**

5.4.1. Referring to the ER Letter ref. CEDD/KL/2009/01/M45/130(369767) dated 14 February 2011, a Supplementary to Baseline Water Quality Monitoring Report – Review Action and Limit Levels (Revision 1.0) has been provided to EPD by ER in February 2011 in according to Sections 4.92 and 10.7 of EM&A Manual. This report in Revision 1.1 has been provided on 26 April 2011 in response to EPD’s comments dated 1 April 2011. This report presents the methodology for enlargement baseline database and the review and determination of the Action and Limit Levels in dry and wet seasons.

5.4.2. On the basis of this Supplementary to Baseline Water Quality Monitoring Report, the maximum SS levels in the establishment of larger baseline database will be applied and acted as the upper bound of natural variation levels for the comparison with SS results in reporting quarter. The upper bound of natural variation levels are shown in **Table 5.4**. The graphic presentation of water quality results with respect to local variation is shown in **Appendix 5.3**.

**Table 5.4 Upper Bound of Natural Variation Levels at Water Monitoring Stations**

Upper Bound of Natural Variation Levels (mg/L)	WSD9	WSD10	WSD15	WSD17	WSD19	WSD21
Dry Season	12.0	19.0	14.0	16.0	18.0	15.0
Wet Season	15.1	21.2	22.7	17.9	17.1	18.8

5.4.3. According to the graphic presentation, most SS results were well within the upper bound of natural variation levels.

5.4.4. Based on the graphic presentation and the trend description of the SS levels in **Appendix 4.2**, conclusion of the water quality surveillance can be draw as follows:

- One SS result recorded on 10 Oct 2012 was higher than Trigger Level and two SS results recorded on 25 Oct 2012 were equal to Trigger Level. Moreover, SS levels at all control points and downstream WSD intakes were below SP1 and well within the Action level;
- When the WSD intakes were located at upstream of the Project, it found that SS level was occasionally higher than the control points and sampling points near dredging area. Thus, uncertain interference of water quality was apparently interfering in the vicinity of intakes frequently;

5.4.5. With reference to the upper bound of natural variation levels and water quality surveillance conducting in reporting period, it shows no fluctuation over the upper bound most of the time and hence this further supports such exceedance is not caused by dredging activities.

### Summary of Investigation

5.4.6. To summarize, it was found in this reporting period that:

- SS exceedances located at upstream of the Project site and no rising SS level in downstream across the Victoria Harbour after passing the project location. For the recorded downstream SS exceedances, no rising of SS was recorded at other downstream stations, and were due to localized impact. It definitely concluded that these exceedances were not related to the Project works.

5.4.7. Since the investigations found that the exceedances recorded in the reporting quarter was not related to the Project, it was concluded that all necessary steps under Event and Action Plan had been taken. The details of Event and Action Plans and Notification of Exceedance summarizing the finding of investigation, possible causes can be referred to the Monthly EM&A Reports.

### **5.5. Site Audit**

5.5.1. There was no non-compliance from the site audits in the reporting period. During environmental site inspections conducted during the reporting quarter, no particular finding was obtained on the dredging works during the site inspections.

### **5.6. Summary of action taken in the event of and follow-up on non-compliance**

5.6.1. Since the exceedances recorded were not project-related, follow-up mitigation measures were therefore not required.

**6. COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION**

6.0.1. In the reporting quarter, no complaints, notification of summons or prosecution was received in the reporting period. Cumulative statistic on complaints and successful prosecutions are summarized in **Table 6.1**, **Table 6.2** and **Table 6.3** respectively.

**Table 6.1 Environmental Complaints Log**

Complaint Log No.	Date of Receipt	Received From and Received By	Nature of Complaint	Date Investigated	Outcome	Date of Reply
NIL	-	-	-	-	-	-

**Table 6.2 Cumulative Statistics on Complaints**

Environmental Parameters	Cumulative No. Brought Forward	No. of Complaints This Month	Cumulative No. Project-to-Date
Air	0	0	0
Noise	0	0	0
Water	0	0	0
Waste	0	0	0
<b>Total</b>	<b>0</b>	<b>0</b>	<b>0</b>

**Table 6.3 Cumulative Statistics on Successful Prosecutions**

Environmental Parameters	Cumulative No. Brought Forward	No. of Successful Prosecutions this month (Offence Date)	Cumulative No. Project-to-Date
Air	0	0	0
Noise	0	0	0
Water	0	0	0
Waste	0	0	0
<b>Total</b>	<b>0</b>	<b>0</b>	<b>0</b>





## 7. CONCLUSION

- 7.0.1. The EM&A programme was carried out in accordance with the EM&A Manual requirements, minor alterations to the programme proposed were made in response to changing circumstances.
- 7.0.2. Nine action level exceedances and twenty-one limit level exceedances of SS concentration, and twenty-six action level exceedances and one limit level exceedances of turbidity were recorded in the reporting period. Investigations found that the exceedances were either located at the upstream station of the Project site or due to localized impact, and not due to the Project work. It is concluded that no adverse water quality impact was arising from the Project works.
- 7.0.3. Supplementary to Baseline Water Quality Monitoring Report – Review of Action and Limit Levels (Revision 1.2) was submitted to EPD on 13 October 2011. With respect to the EPD's no comment on the new Action and Limit Levels for water monitoring on 19 October 2011, the new set Action and Limit Levels for turbidity and SS was started to use from 19 October 2011.
- 7.0.4. Noise monitoring was not necessary in the reporting period due to non-presence of NSR.
- 7.0.5. The construction programmes in reporting quarter are provided in **Appendix 7.1**.



**Figure 2.1**  
**General Layout**

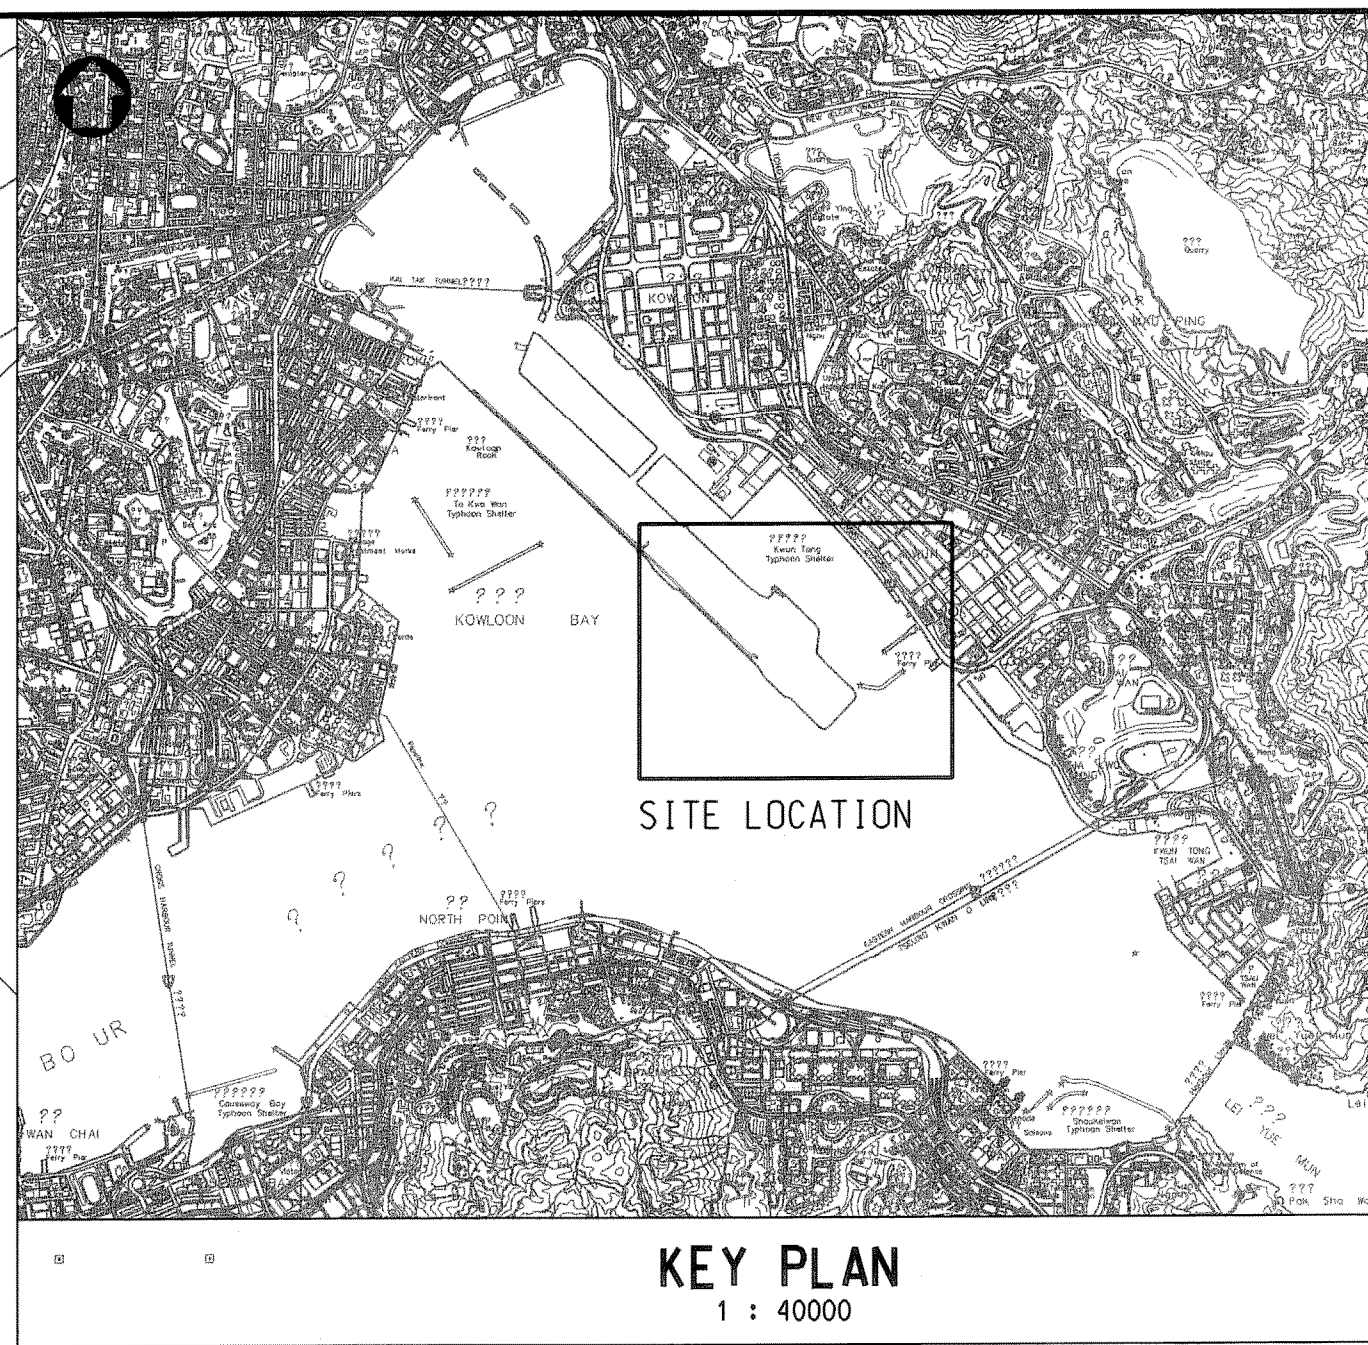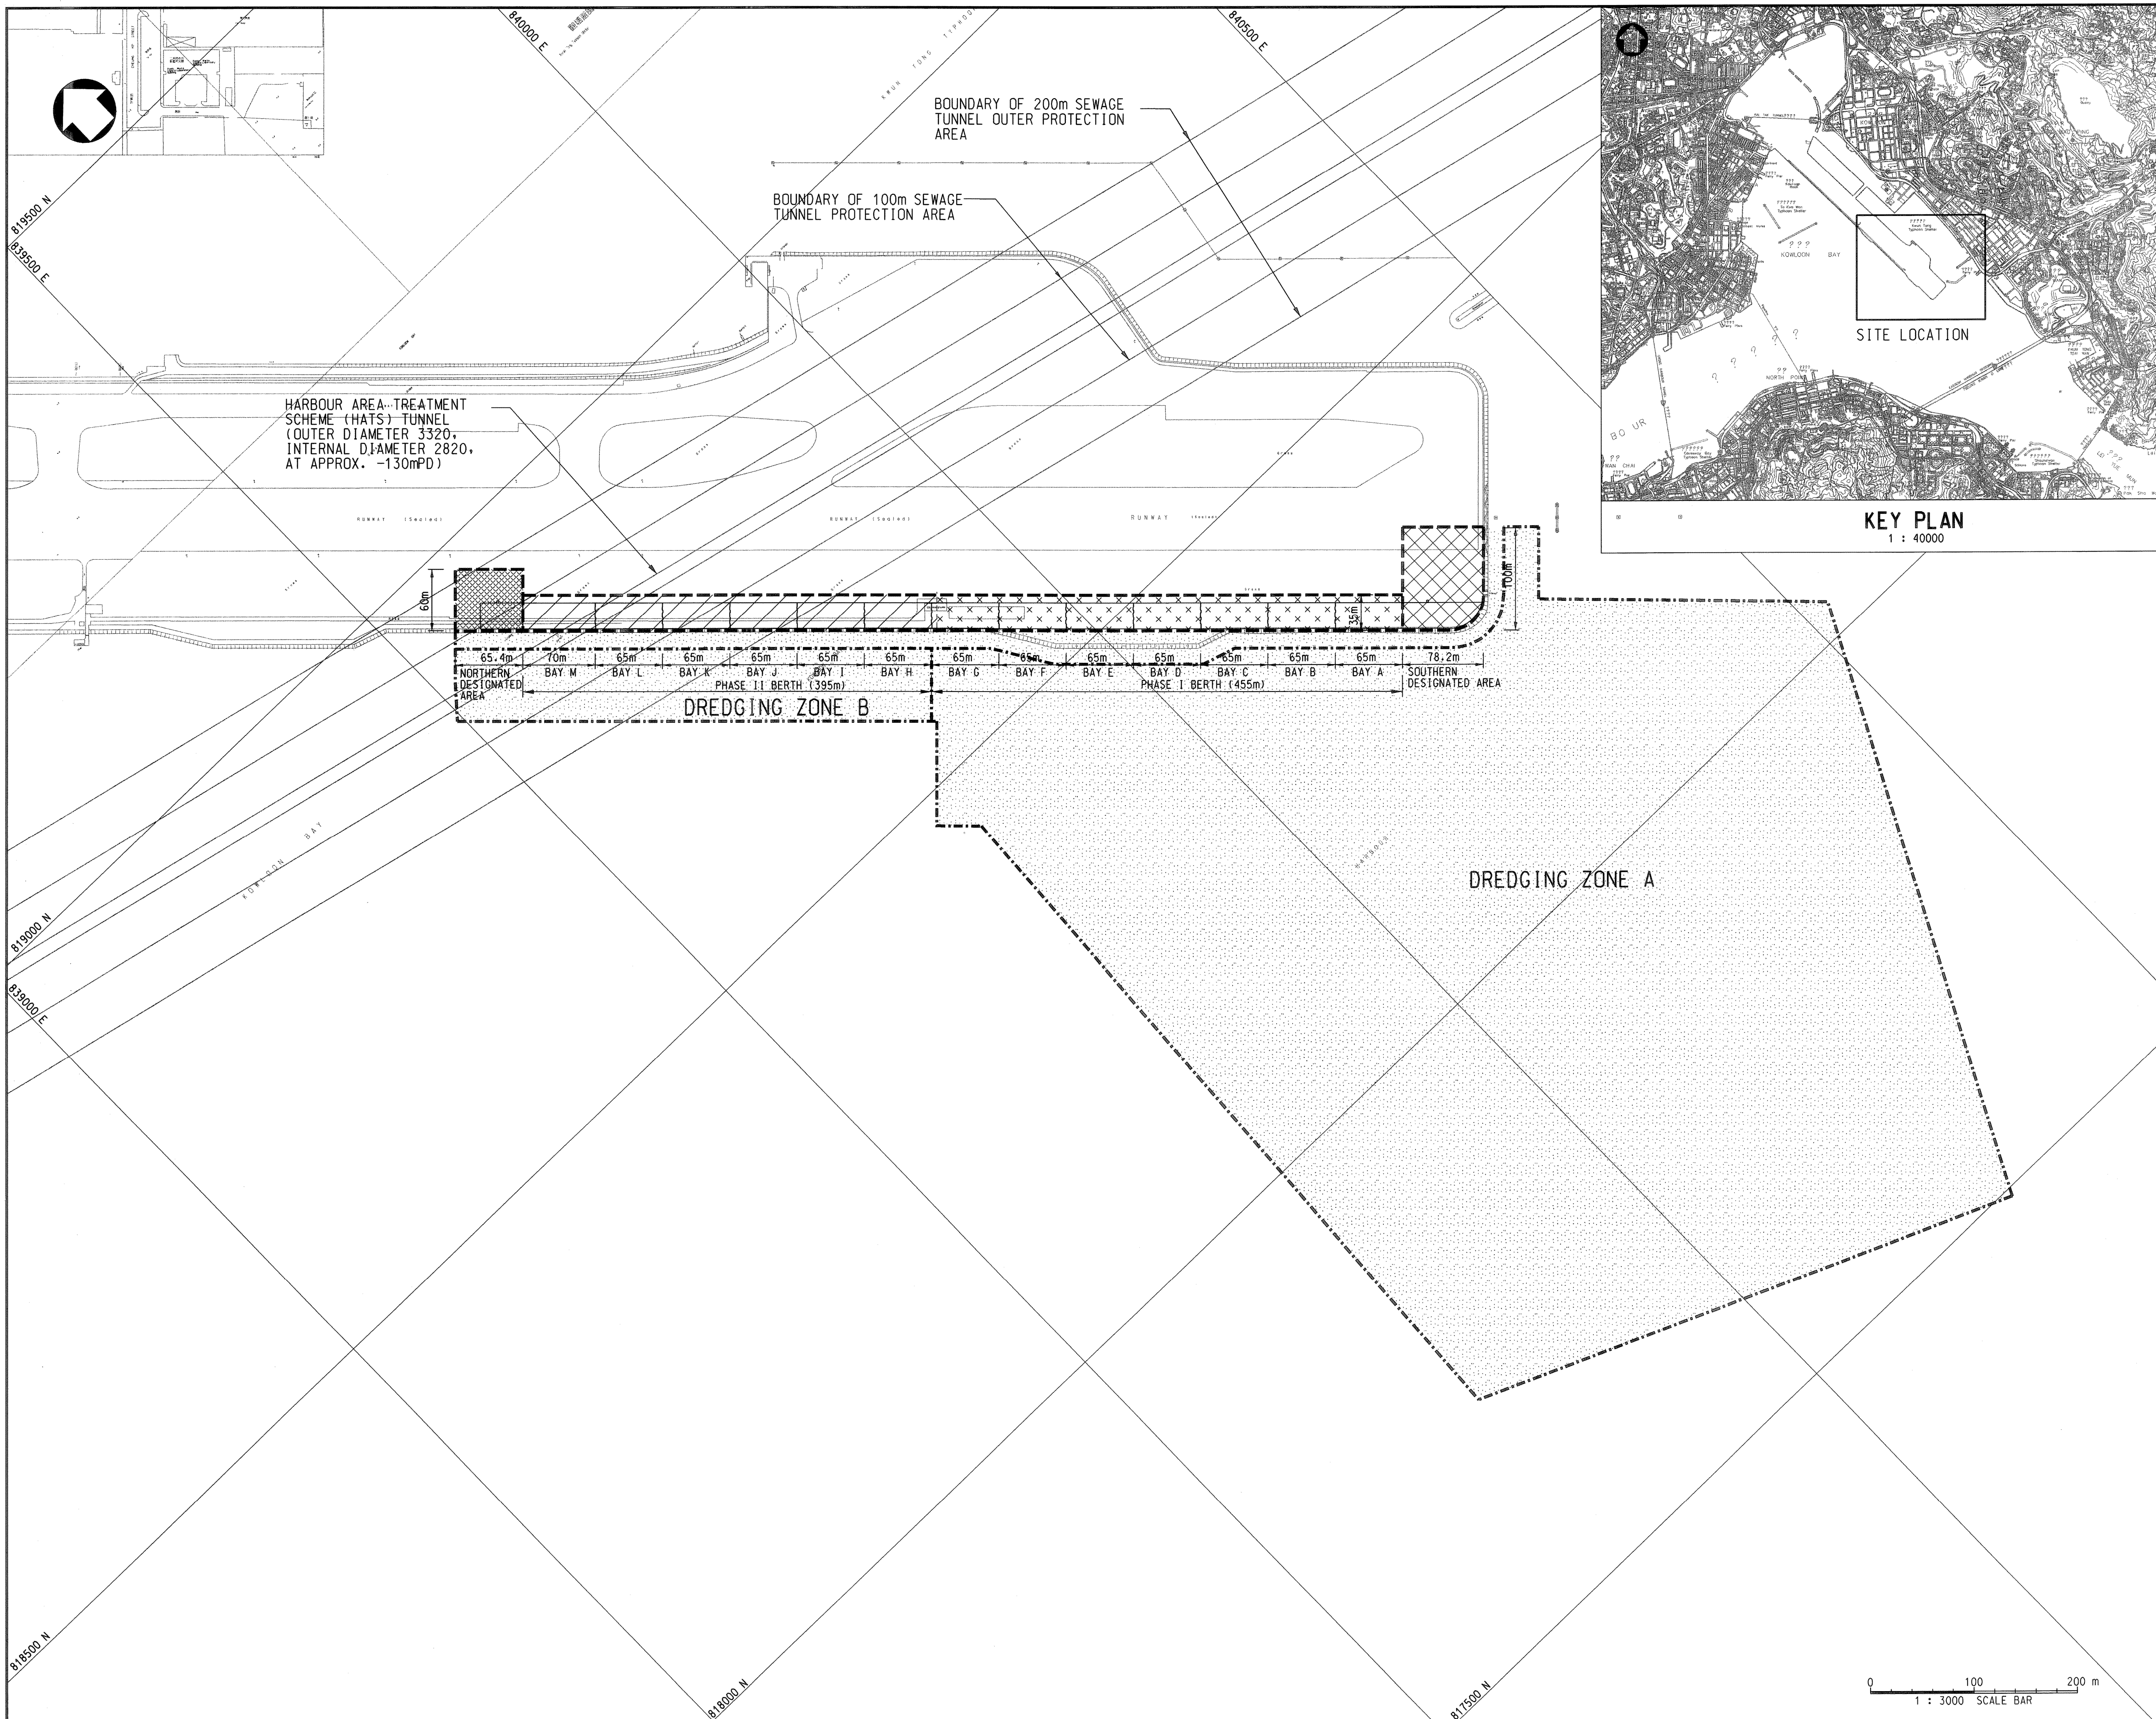

- NOTES:**
1. ALL COORDINATES ARE RELATED TO HONG KONG METRIC GRID (1980).
  2. ALL DIMENSIONS ARE IN METRES UNLESS OTHERWISE SPECIFIED.
  3. SETTING OUT REFER TO DRAWING NO.08290/1021.

- LEGEND:**
- SOUTHERN DESIGNATED AREA
  - NORTHERN DESIGNATED AREA
  - DREDGING ZONE / SEAWALL REMOVAL
  - PHASE I BERTH AREA
  - PHASE II BERTH AREA

Rev.	Date	Description	LC	CS
06/09		TENDER		
Rev.	Date	Description	Drawn	Checked
		內容修訂	繪圖	校核


土木工程拓展署  
**CEPD** Civil Engineering and  
 Development Department

Contract No.KL200901  
 Site Formation for Kai Tak Cruise  
 Terminal Development

**GENERAL LAYOUT PLAN**

Drawing No. 圖則編號	<b>08290/1011</b>			
Designed 設計	Drawn 繪圖	Checked 校核	Scale 比例	
BK	WHM	WCS	1:3000	
Approved 核准	Date 日期	Status 現況	TENDER	
<i>(Signature)</i>	06/09			

Scott Wilson Ltd  
 偉信顧問集團有限公司

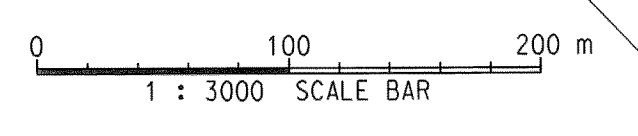




**Figure 2.2**

**Project Organization Chart**

**Project Organization Chart**

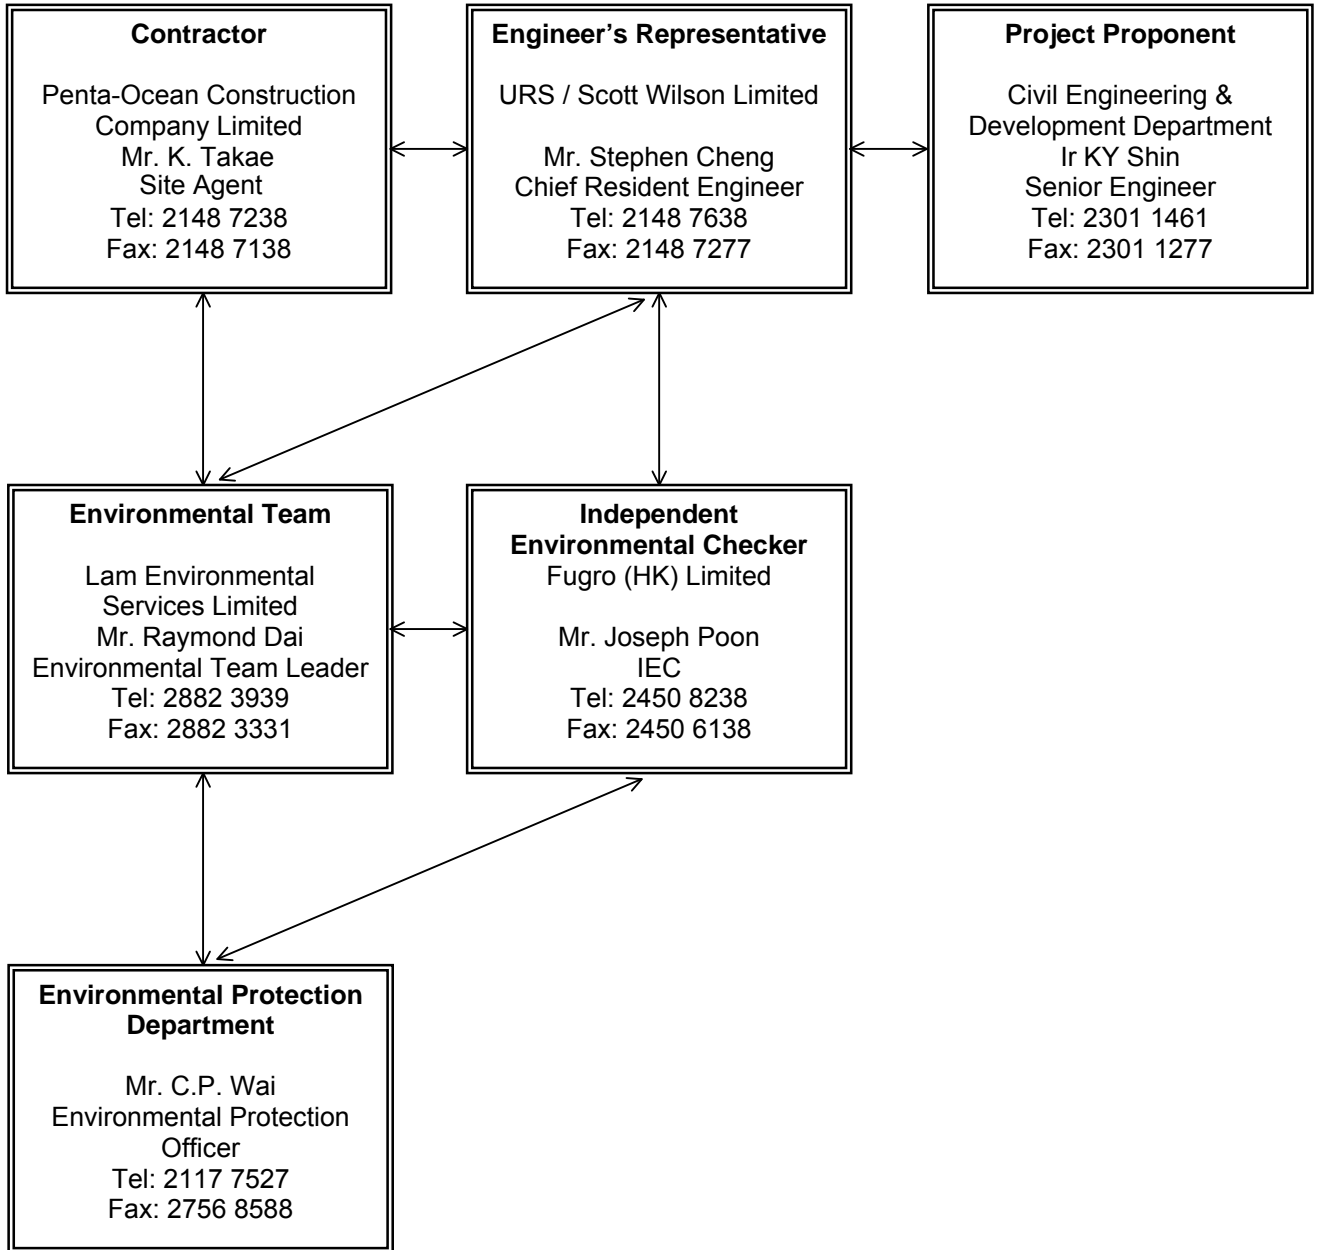








**Figure 3.1**

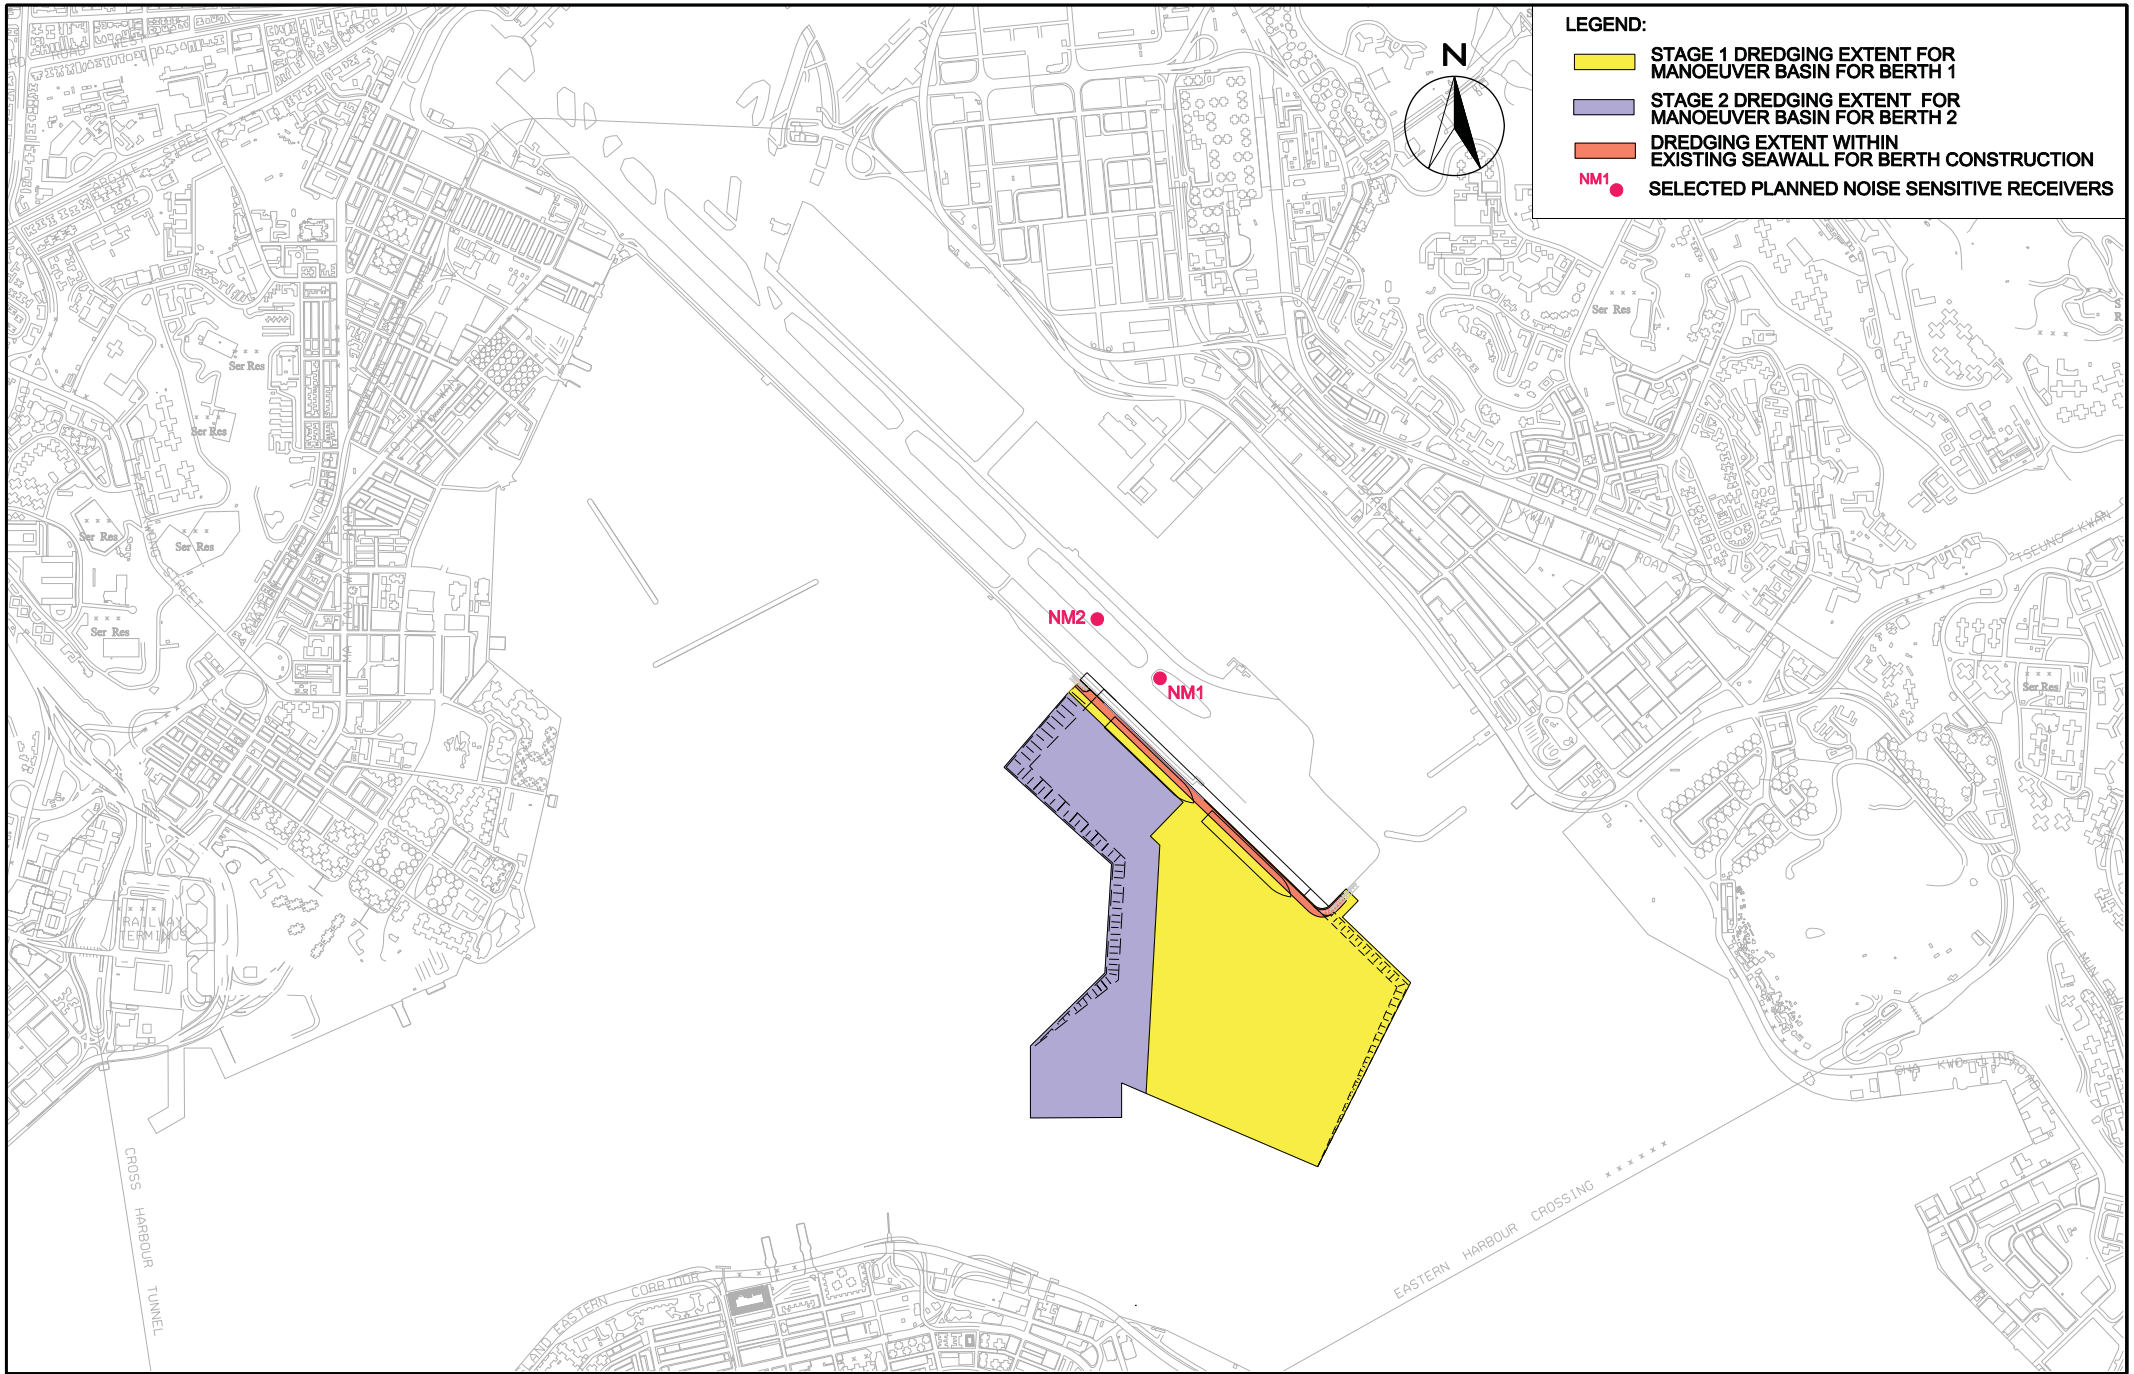***Layout of Environmental Monitoring Stations***





**LEGEND:**

-  STAGE 1 DREDGING EXTENT FOR MANOEUVER BASIN FOR BERTH 1
-  STAGE 2 DREDGING EXTENT FOR MANOEUVER BASIN FOR BERTH 2
-  DREDGING EXTENT WITHIN EXISTING SEAWALL FOR BERTH CONSTRUCTION
-  NM1 ● SELECTED PLANNED NOISE SENSITIVE RECEIVERS




NM2 ●

NM1 ●

CROSS HARBOUR TUNNEL

EASTERN HARBOUR CROSSING

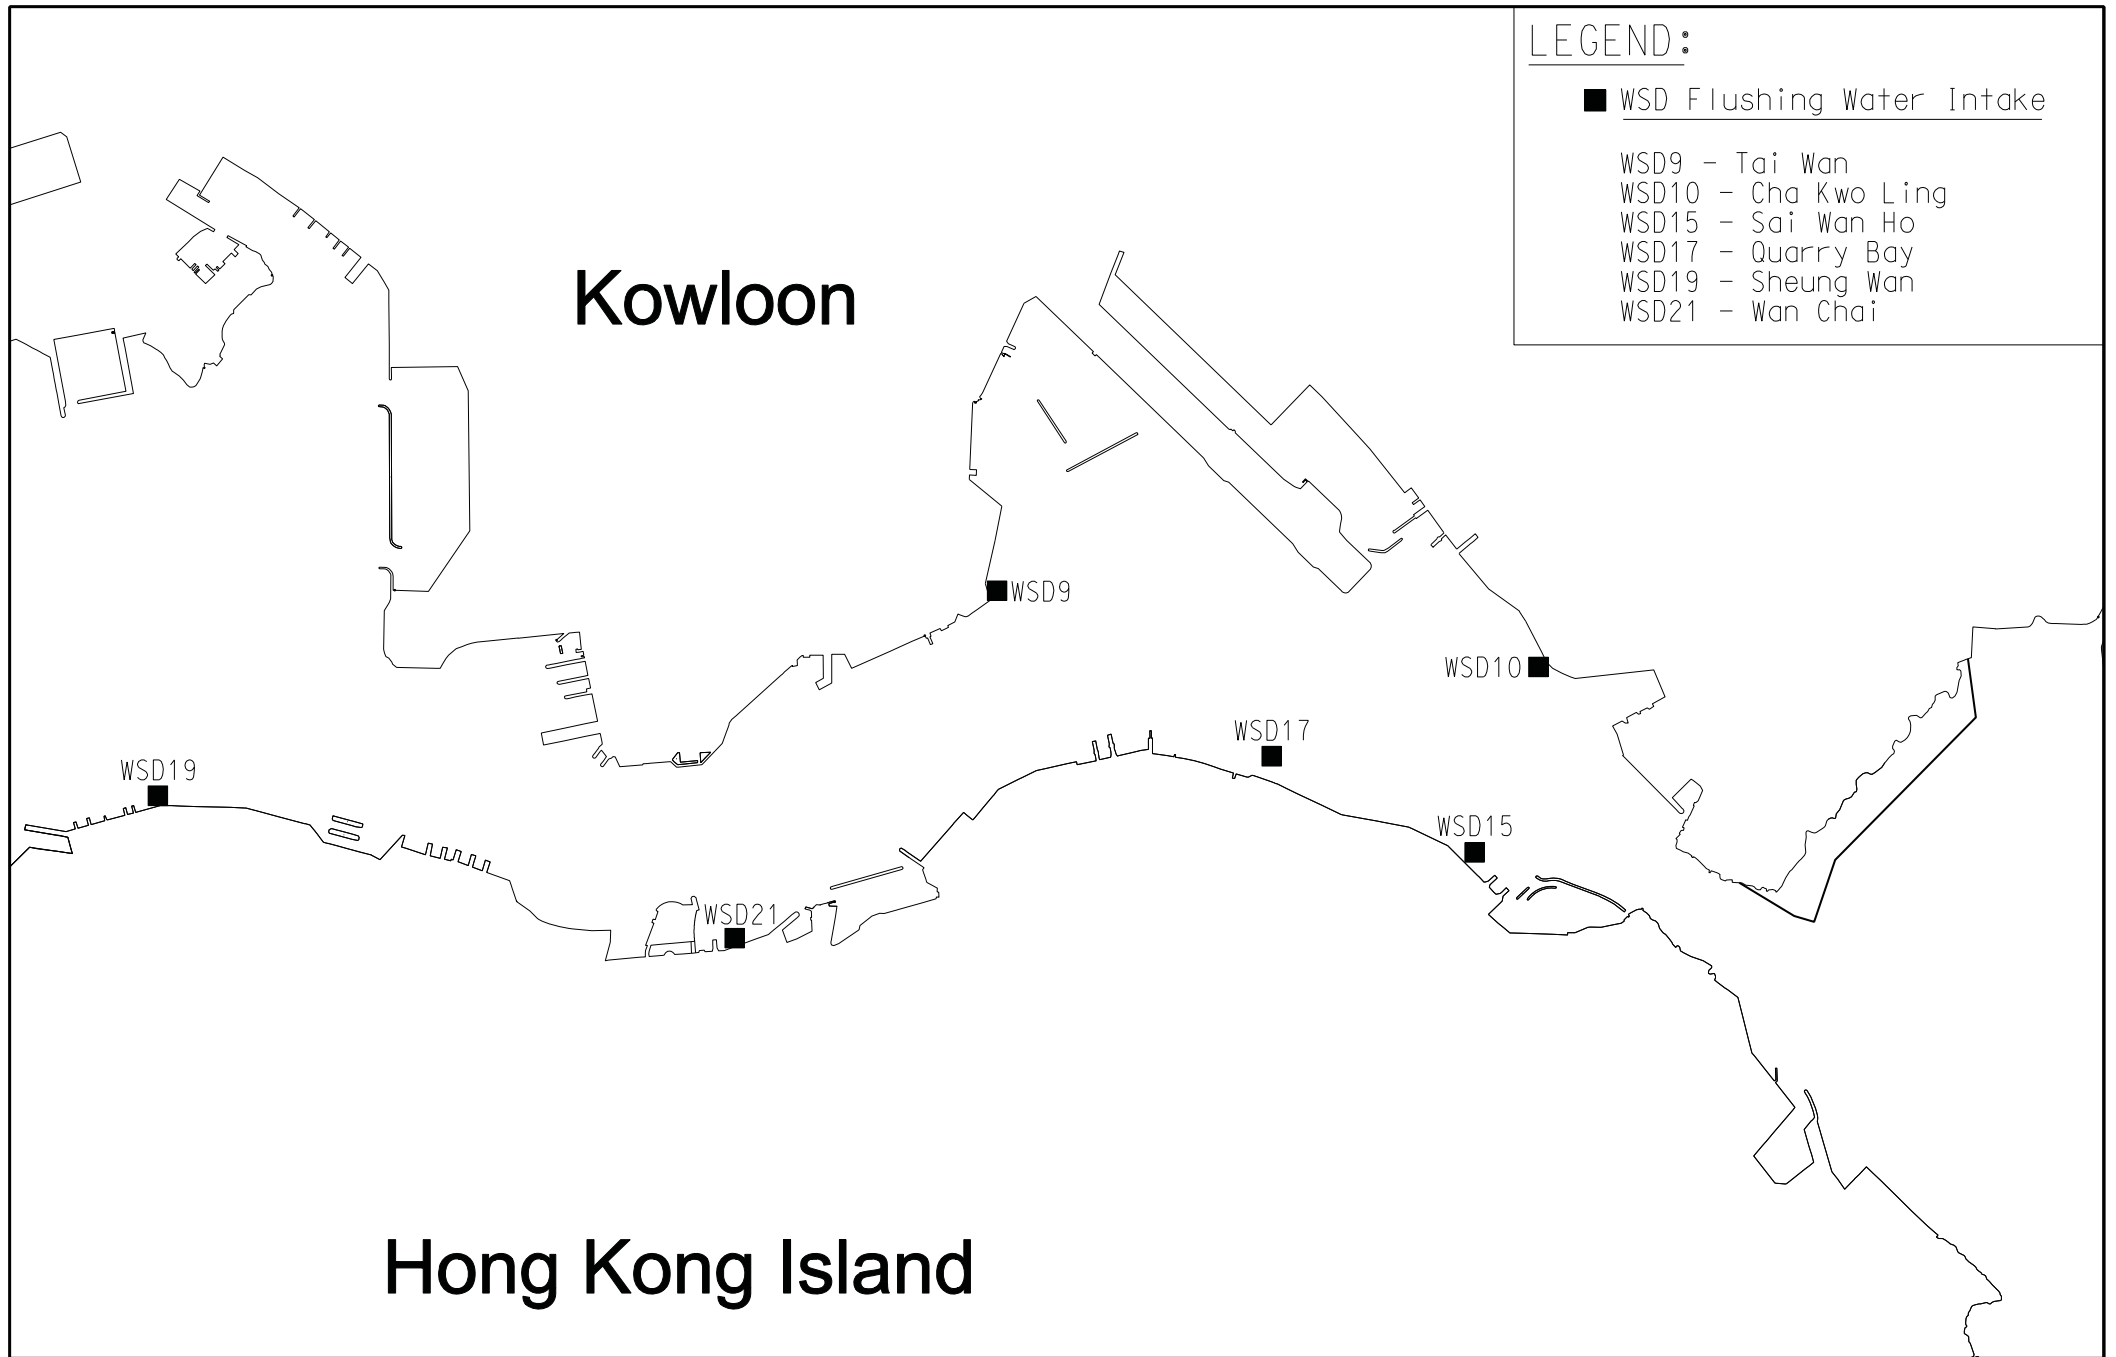


SCALE	A3 1:35000	DATE	AUG 07
CHECK	AKYC	DRAWN	WCM
JOB NO.	60022503	DRAWING NO.	3.1
		REV	-





***Figure 4.1***

***Layout of Monitoring Stations for Water Quality Surveillance System***

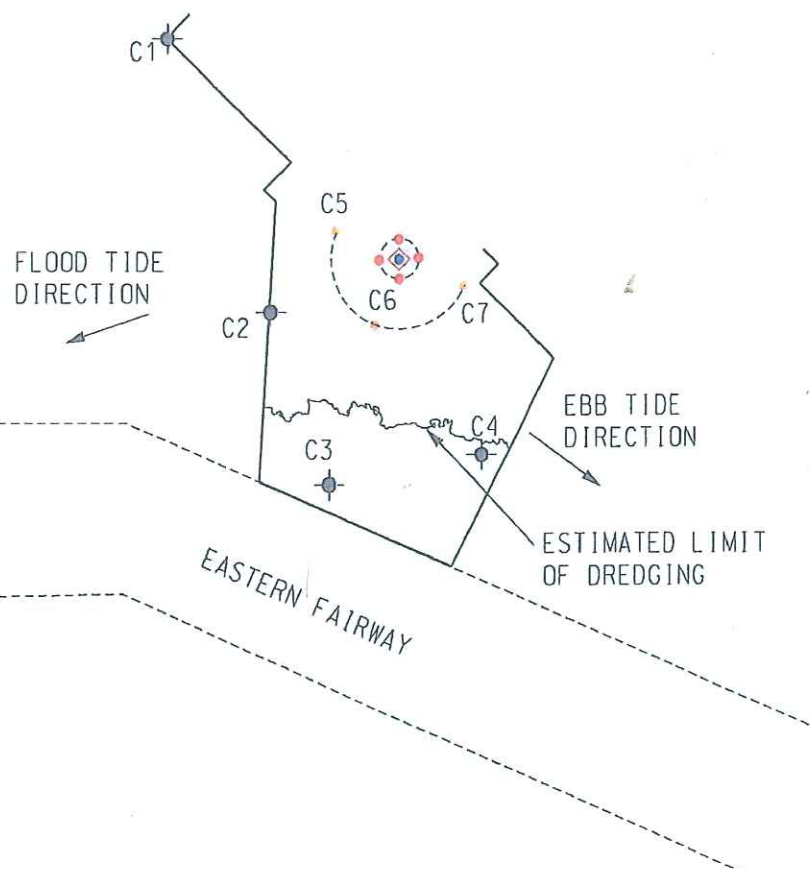

**Scope of Works for Water Quality Surveillance System**

1. The water quality monitoring works comprised of Set A and Set B. The Contractor shall carry out both sets of works (7 sampling stations in total).
2. Set A (4 sampling stations), the water quality monitoring works shall be taken at the Control Points (i.e. C1 to C4). Set B (3 sampling stations), the water quality monitoring works shall be taken at approximate 100m outside the silt curtain (i.e. C5 to C7) which the locations shall be changed from time to time to follow the movement of silt curtain.
3. The water quality monitoring works shall be carried out during the dredging period.
4. The water quality monitoring works shall be carried out at a frequency to be agreed by the Engineer. The date and time of monitoring should be in line with the impact water quality monitoring schedule under the EM&A manual. Each sampling event shall be carried out at 3 depth (i.e. 1m below the surface, mid depth, and 1m above the seabed) of the water column at each location. Duplicate in-situ measurements and water sampling shall be carried out in each sampling event. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides shall not less than 0.5m. The schedule of water quality monitoring shall be reviewed by the Engineer and the Independent Environmental Checker (IEC) depending on whether the water quality monitoring results could indicate any trend of water quality for determination of trigger/action level or whether there is a ad-hoc requirement (e.g. change of working methods, complaints, etc.). The Contractor shall carry out the works according to the revised schedule if instructed by the Engineer.
5. As the key parameters, turbidity shall be measured in situ whereas Suspended Solids (SS) shall be determined by laboratory. Analysis of SS level shall be carried out in a HOKLAS or other international accredited laboratory. Sufficient water samples of not less than 1 liter shall be collected at the monitoring stations for carrying out the laboratory SS determinations.
6. Requirements on the monitoring equipments and calibration shall be referred to Paragraph 4.7 "Monitoring Equipment" of the Environmental Monitoring and Audit Manual for the Dredging Works for Proposed Cruise Terminal at Kai Tak.
7. Laboratory analysis of the sampling data shall be carried out in a HOKLAS or other international accredited laboratory and follow the requirements as stated in Paragraph 4.8 "Laboratory Measurement/Analysis" of the Environmental Monitoring and Audit Manual for the Dredging Works for Proposed Cruise Terminal at Kai Tak. Monitoring data together with the report shall be reported to the Engineer and the IEC on monthly basis.
8. Other relevant data shall also be recorded including monitoring location/position, time, water depth, sampling depth, water temperature, tidal stages, weather conditions and any special phenomena or work underway nearby.

- LEGEND:**
- SILT CURTAIN (20m x 20m)
  - SAMPLING POINT INSIDE SILT CURTAIN (CONTRACTOR'S PROPOSED SAMPLING POINT TO MONITOR EFFECTIVENESS OF SILT CURTAINS)
  - SAMPLING POINT AT ABOUT 10m OUTSIDE SILT CURTAIN (CONTRACTOR'S PROPOSED SAMPLING POINT TO MONITOR EFFECTIVENESS OF SILT CURTAINS)
  - ⊕ SAMPLING POINT AS CONTROL POINT (C1 TO C4) (ADDITIONAL)
  - ⊕ SAMPLING POINT AS CONTROL POINT (C5 TO C7) AT ABOUT 100m AWAY FROM SILT CURTAIN (ADDITIONAL)

**ADDITIONAL WATER QUALITY MONITORING STATIONS**

COORDINATE	NORTH	EAST
C1	018867.763	839495.740
C2	018152.875	839775.604
C3	017702.168	839931.601
C4	017780.785	840334.093
C5		
C6		POSITIONS CHANGE WITH SILT CURTAIN
C7		

— SITE BOUNDARY

Control Copy  
No. 35

RECEIVED  
22 SEP 2010

BY: 001367  
(341819) Y.C.#5


B	09/10	REVISION AS SHOWN	EW	JK
A	07/10	REVISION AS SHOWN	JY	SC
Scale	Date	Revision	Drawn	Checked

CEED CONTRACT KL/2009/01  
SITE FORMATION FOR KAI TAK  
CRUISE TERMINAL DEVELOPMENT

WATER QUALITY SURVEILLANCE SYSTEM

SKETCH NO.	(CEED/CL/2009/01)SK0067B
DATE	08/10
CHECKED	AT
APPROVED	SC
AFFECTED Dwg. NO.	
SCALE	NTS

URS SCOTT WILSON LTD  
Engineer for the Contract  
ENGINEERS REPRESENTATIVES OFFICE

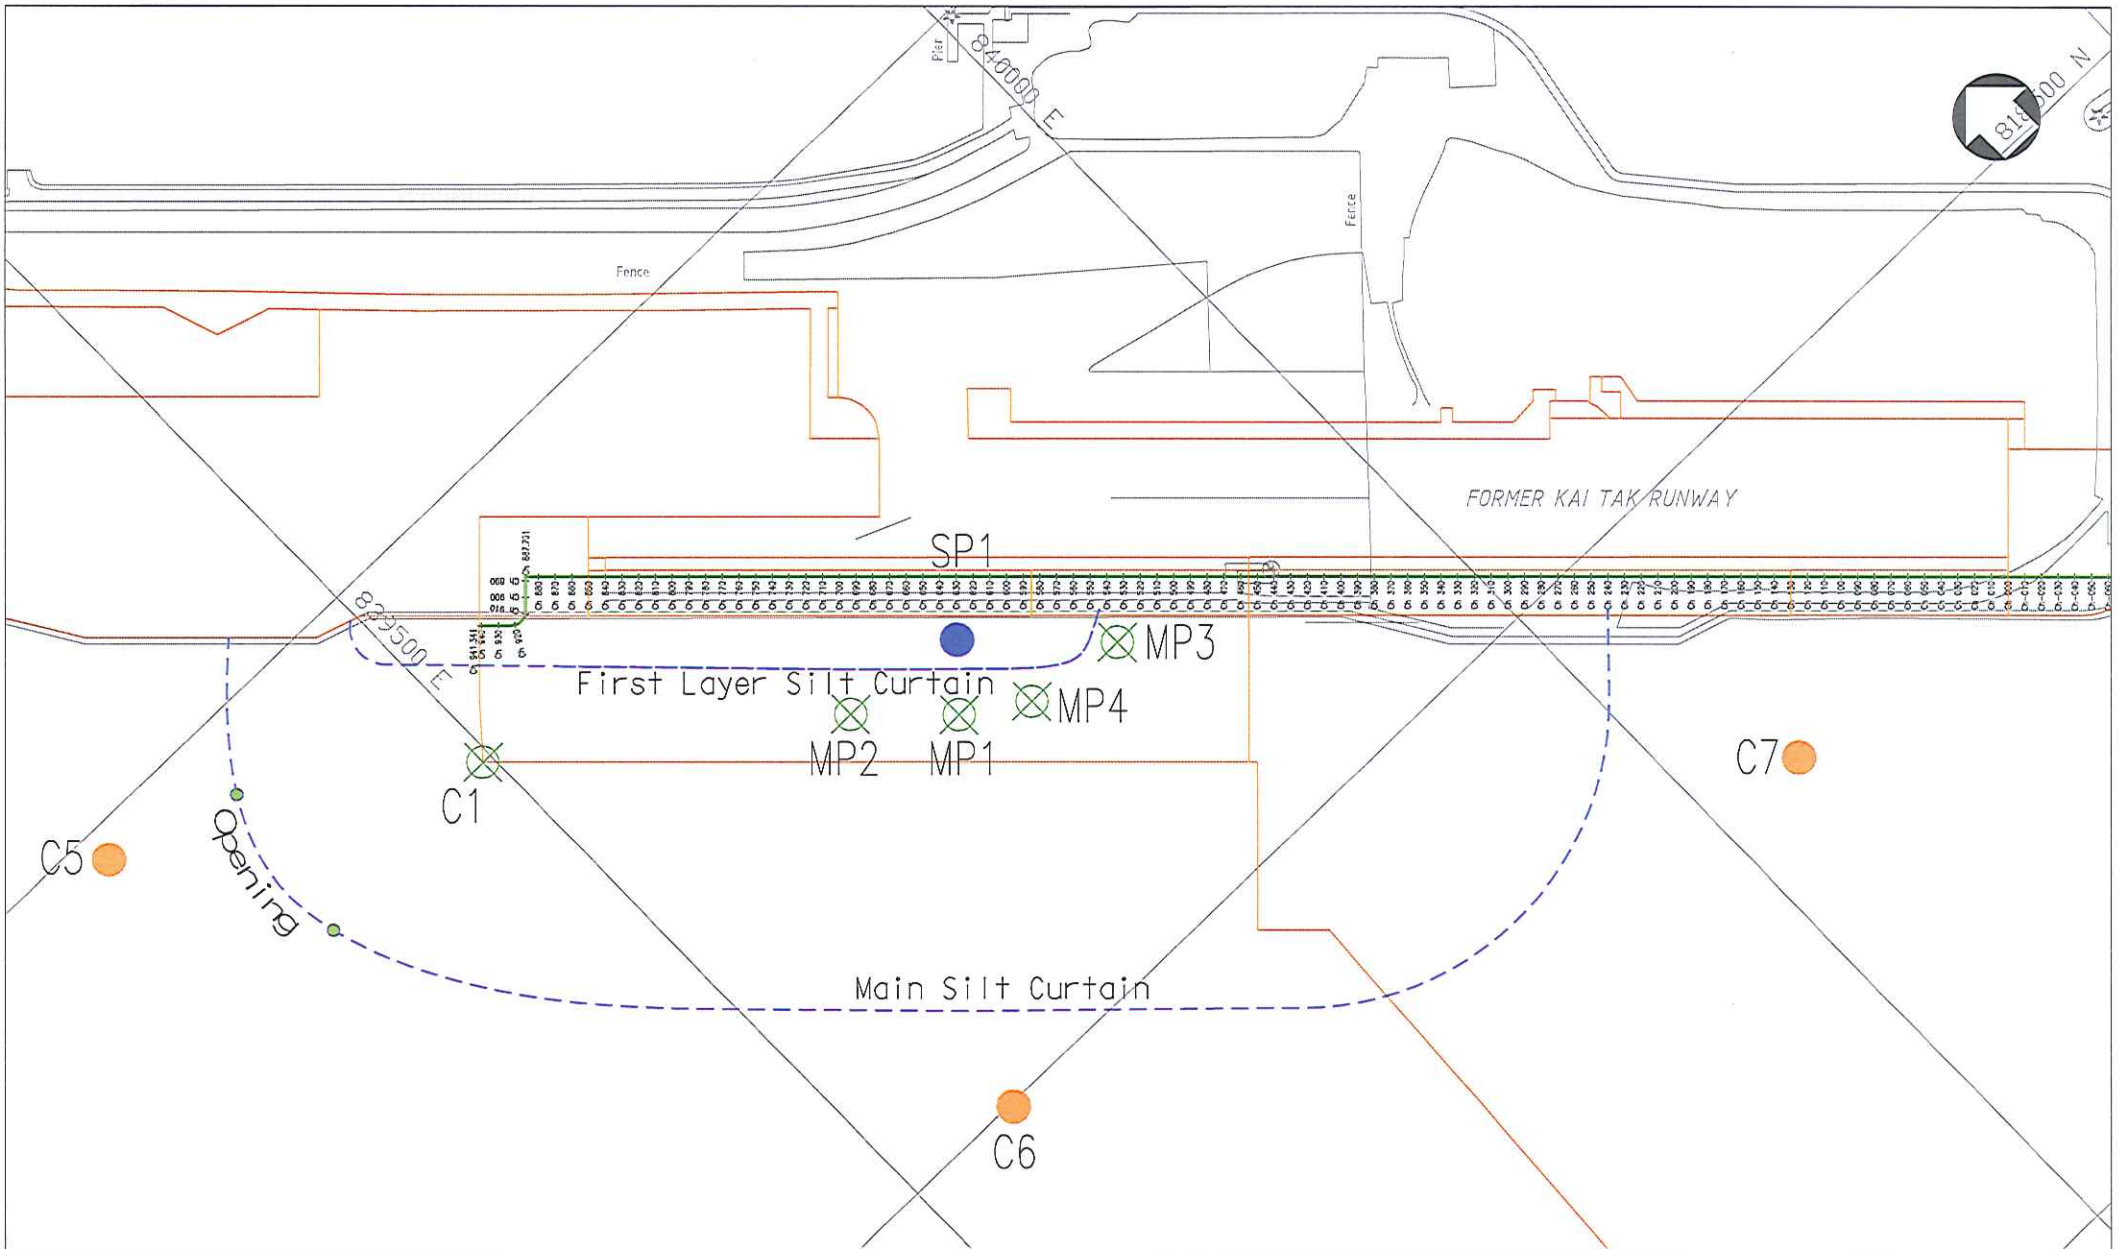

PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**


TITLE  
 Water Quality Surveillance System – 3 Sep 2012

DATE  
 17 Sep 2012

PREPARED BY  
 HP

SCALE  
 NOT TO SCALE

SKETCH No.  
 SK-0879

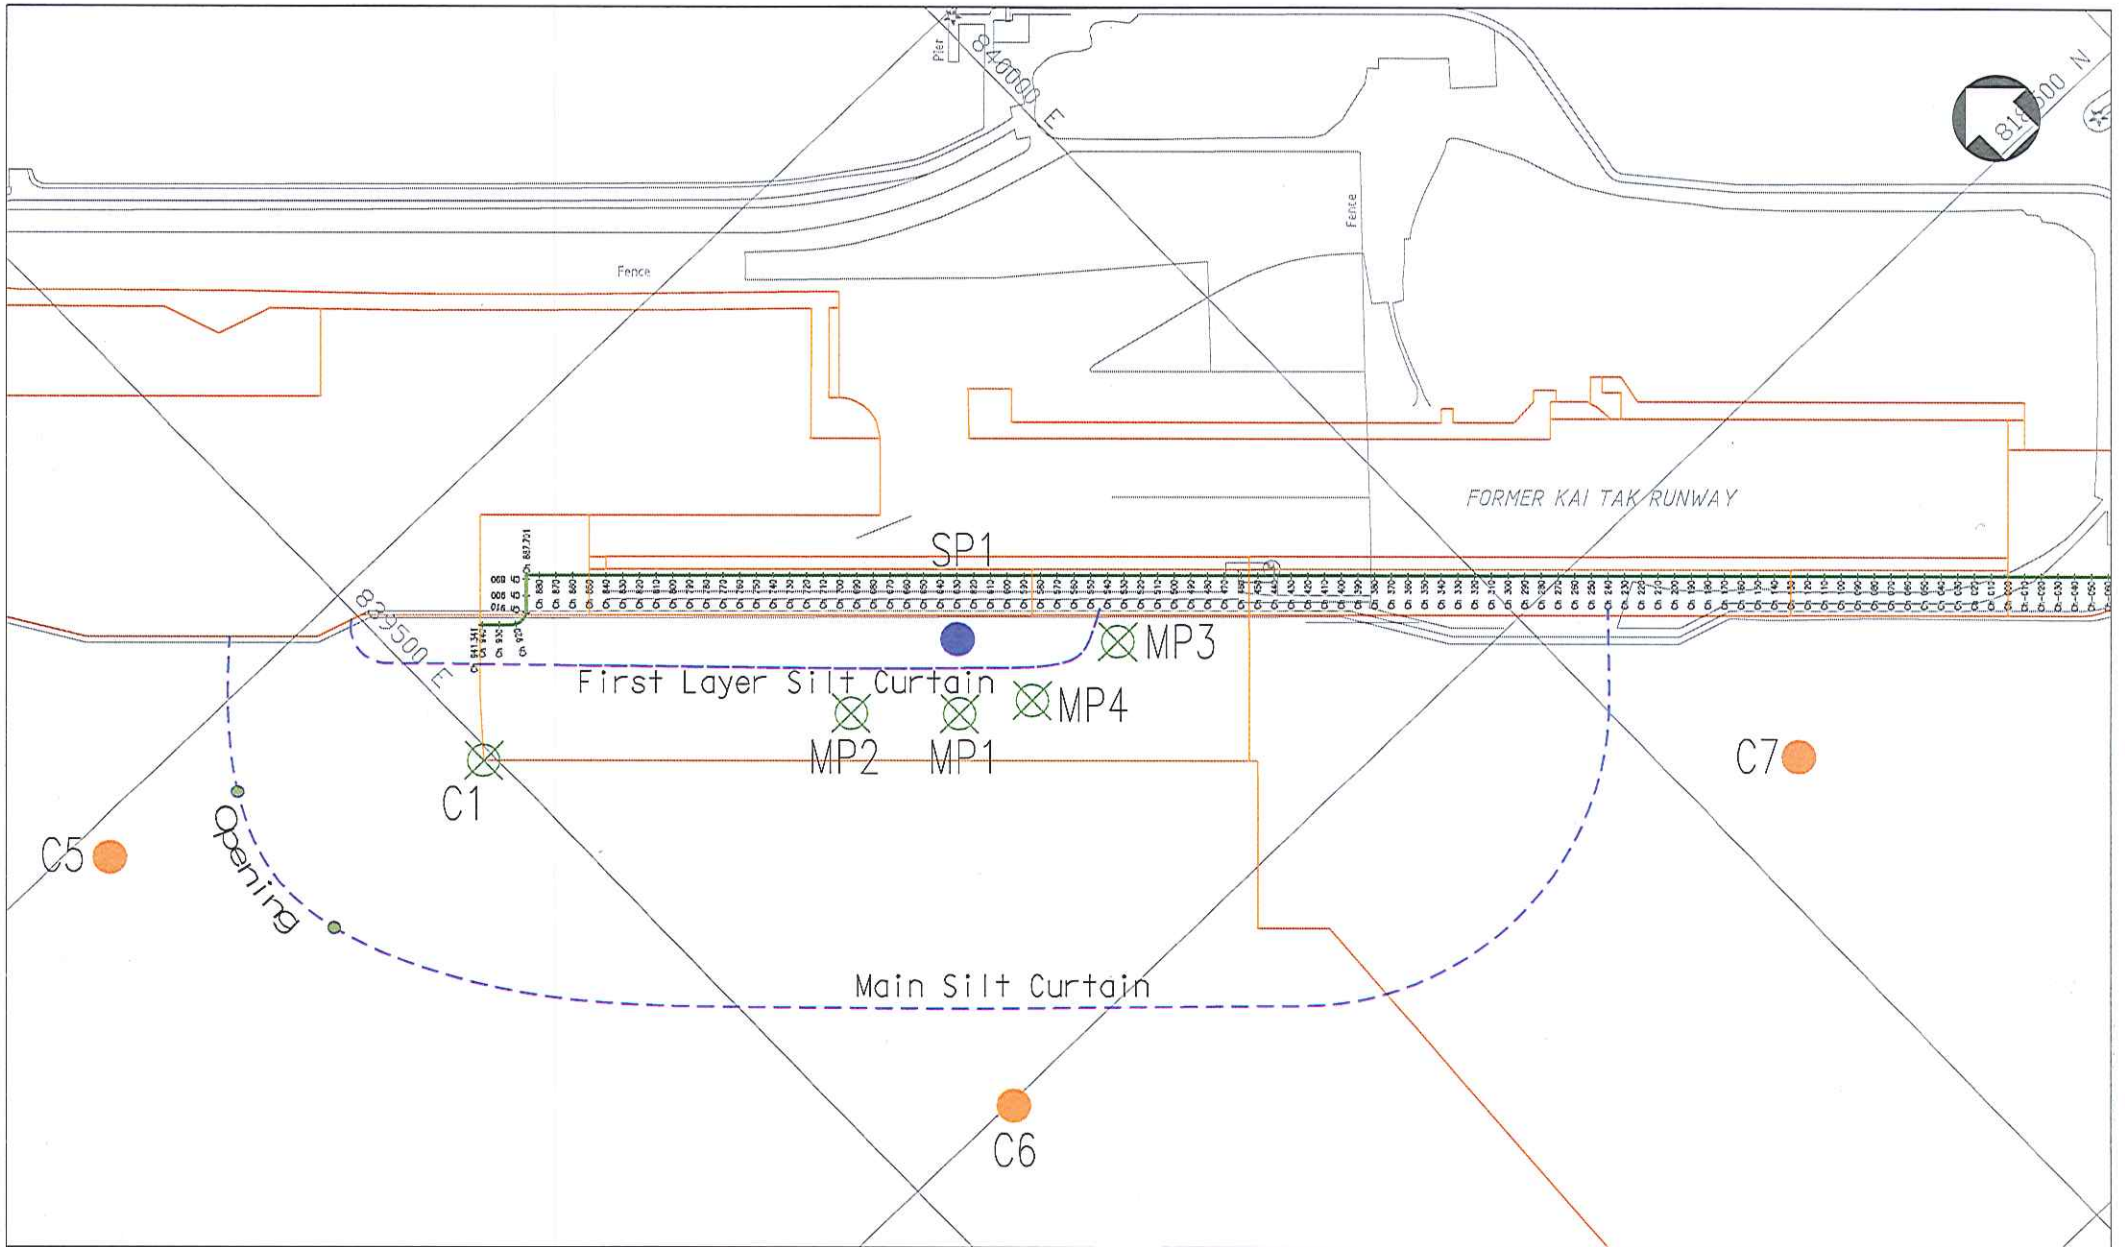

PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**

TITLE  
Water Quality Surveillance System – 19 Sep 2012


DATE  
09 Oct 2012

PREPARED BY  
HP

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0911



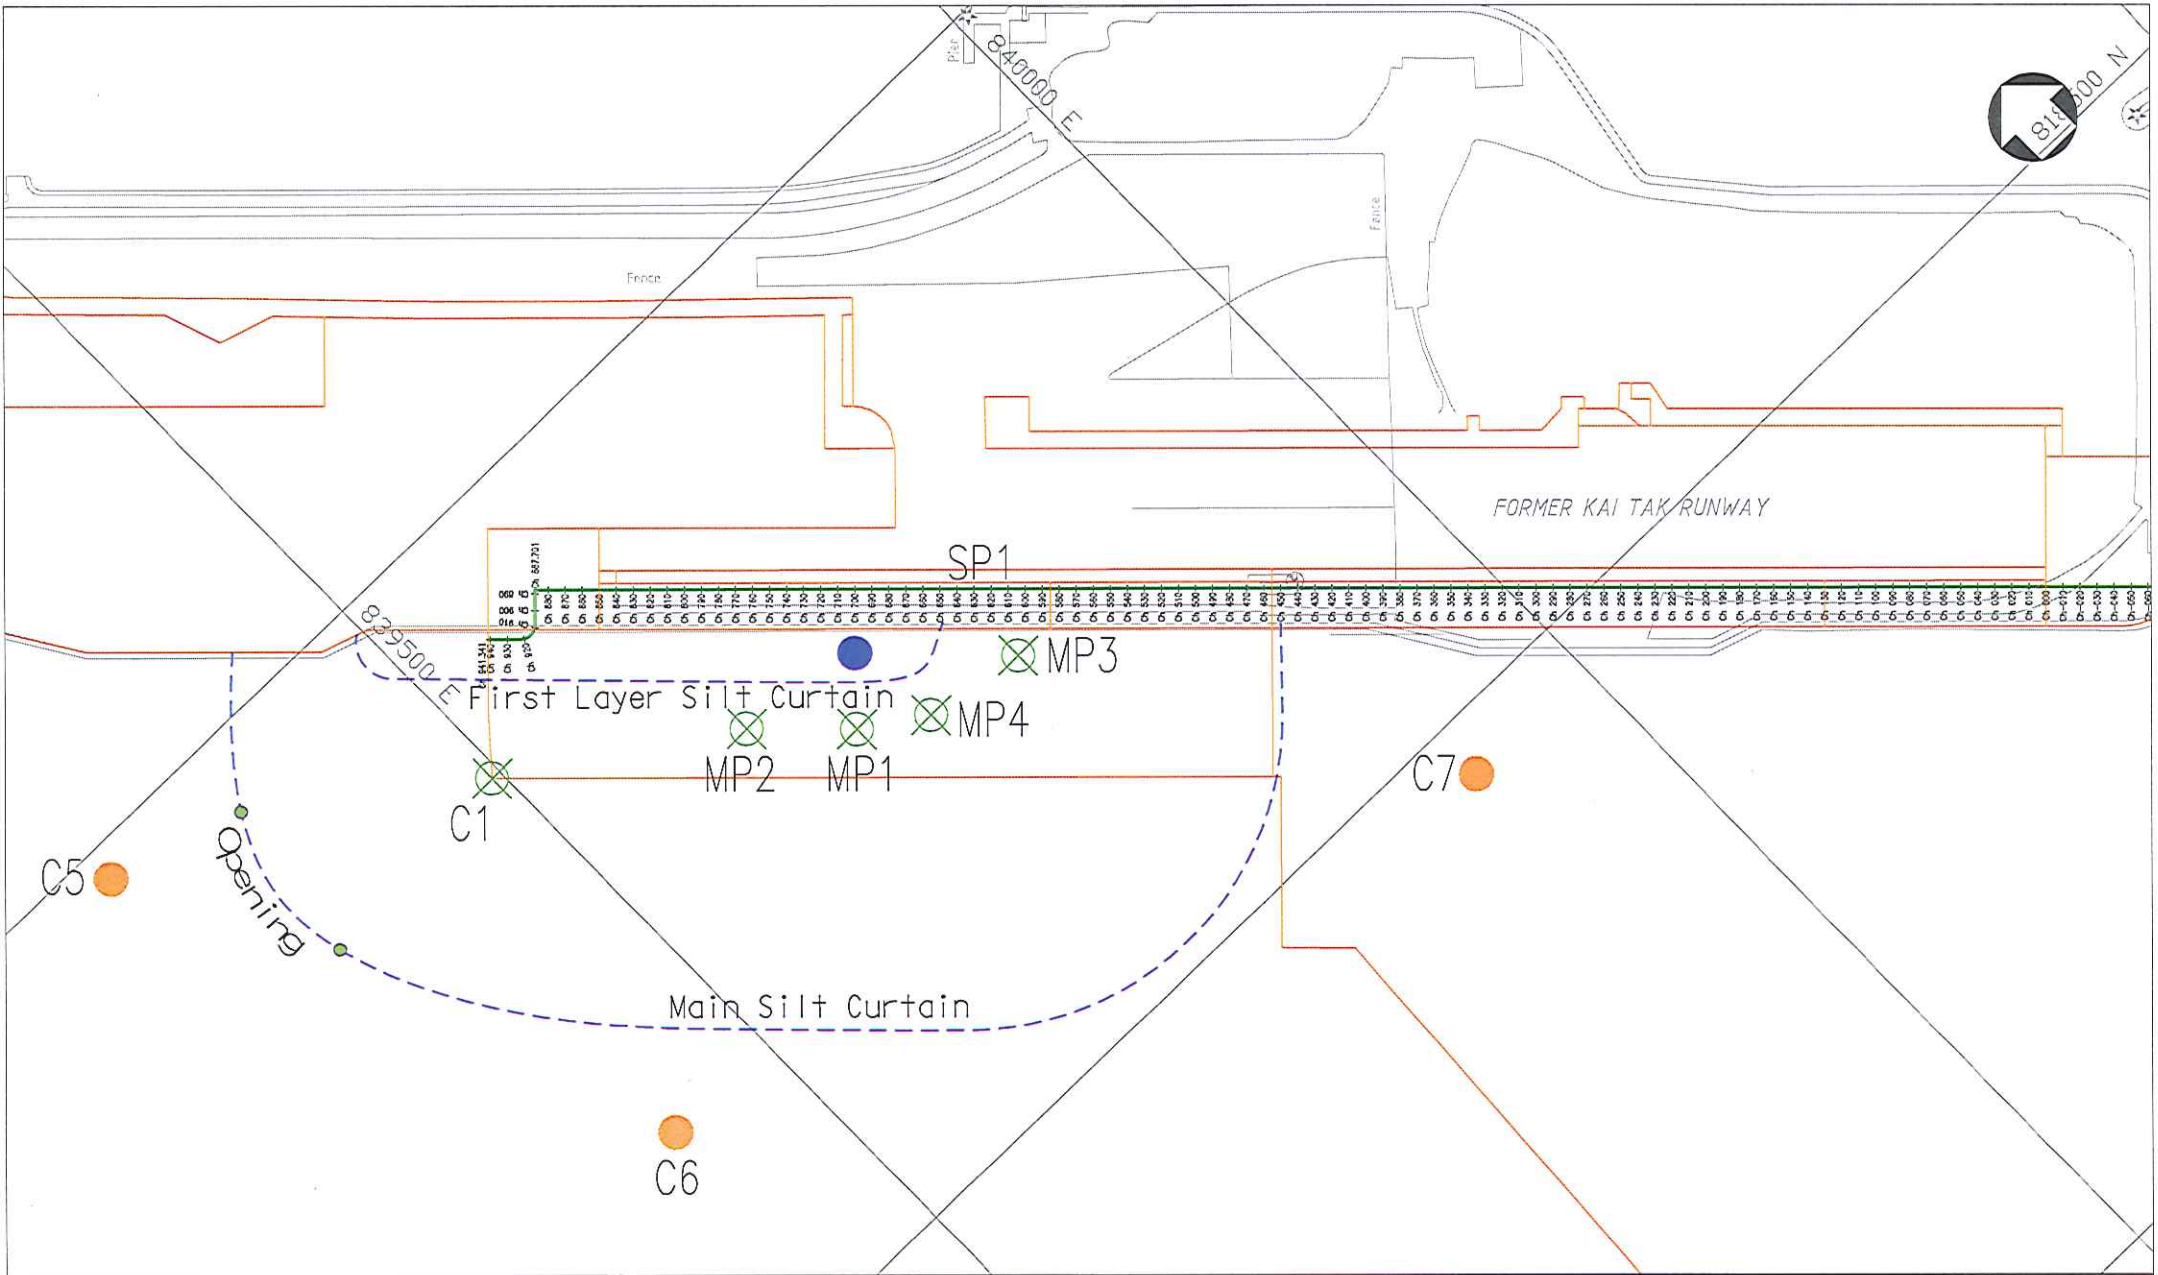

PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**


TITLE  
 Water Quality Surveillance System – 10 Oct 2012

DATE  
 24 Oct 2012

PREPARED BY  
 PY

SCALE  
 NOT TO SCALE

SKETCH No.  
 SK-0936

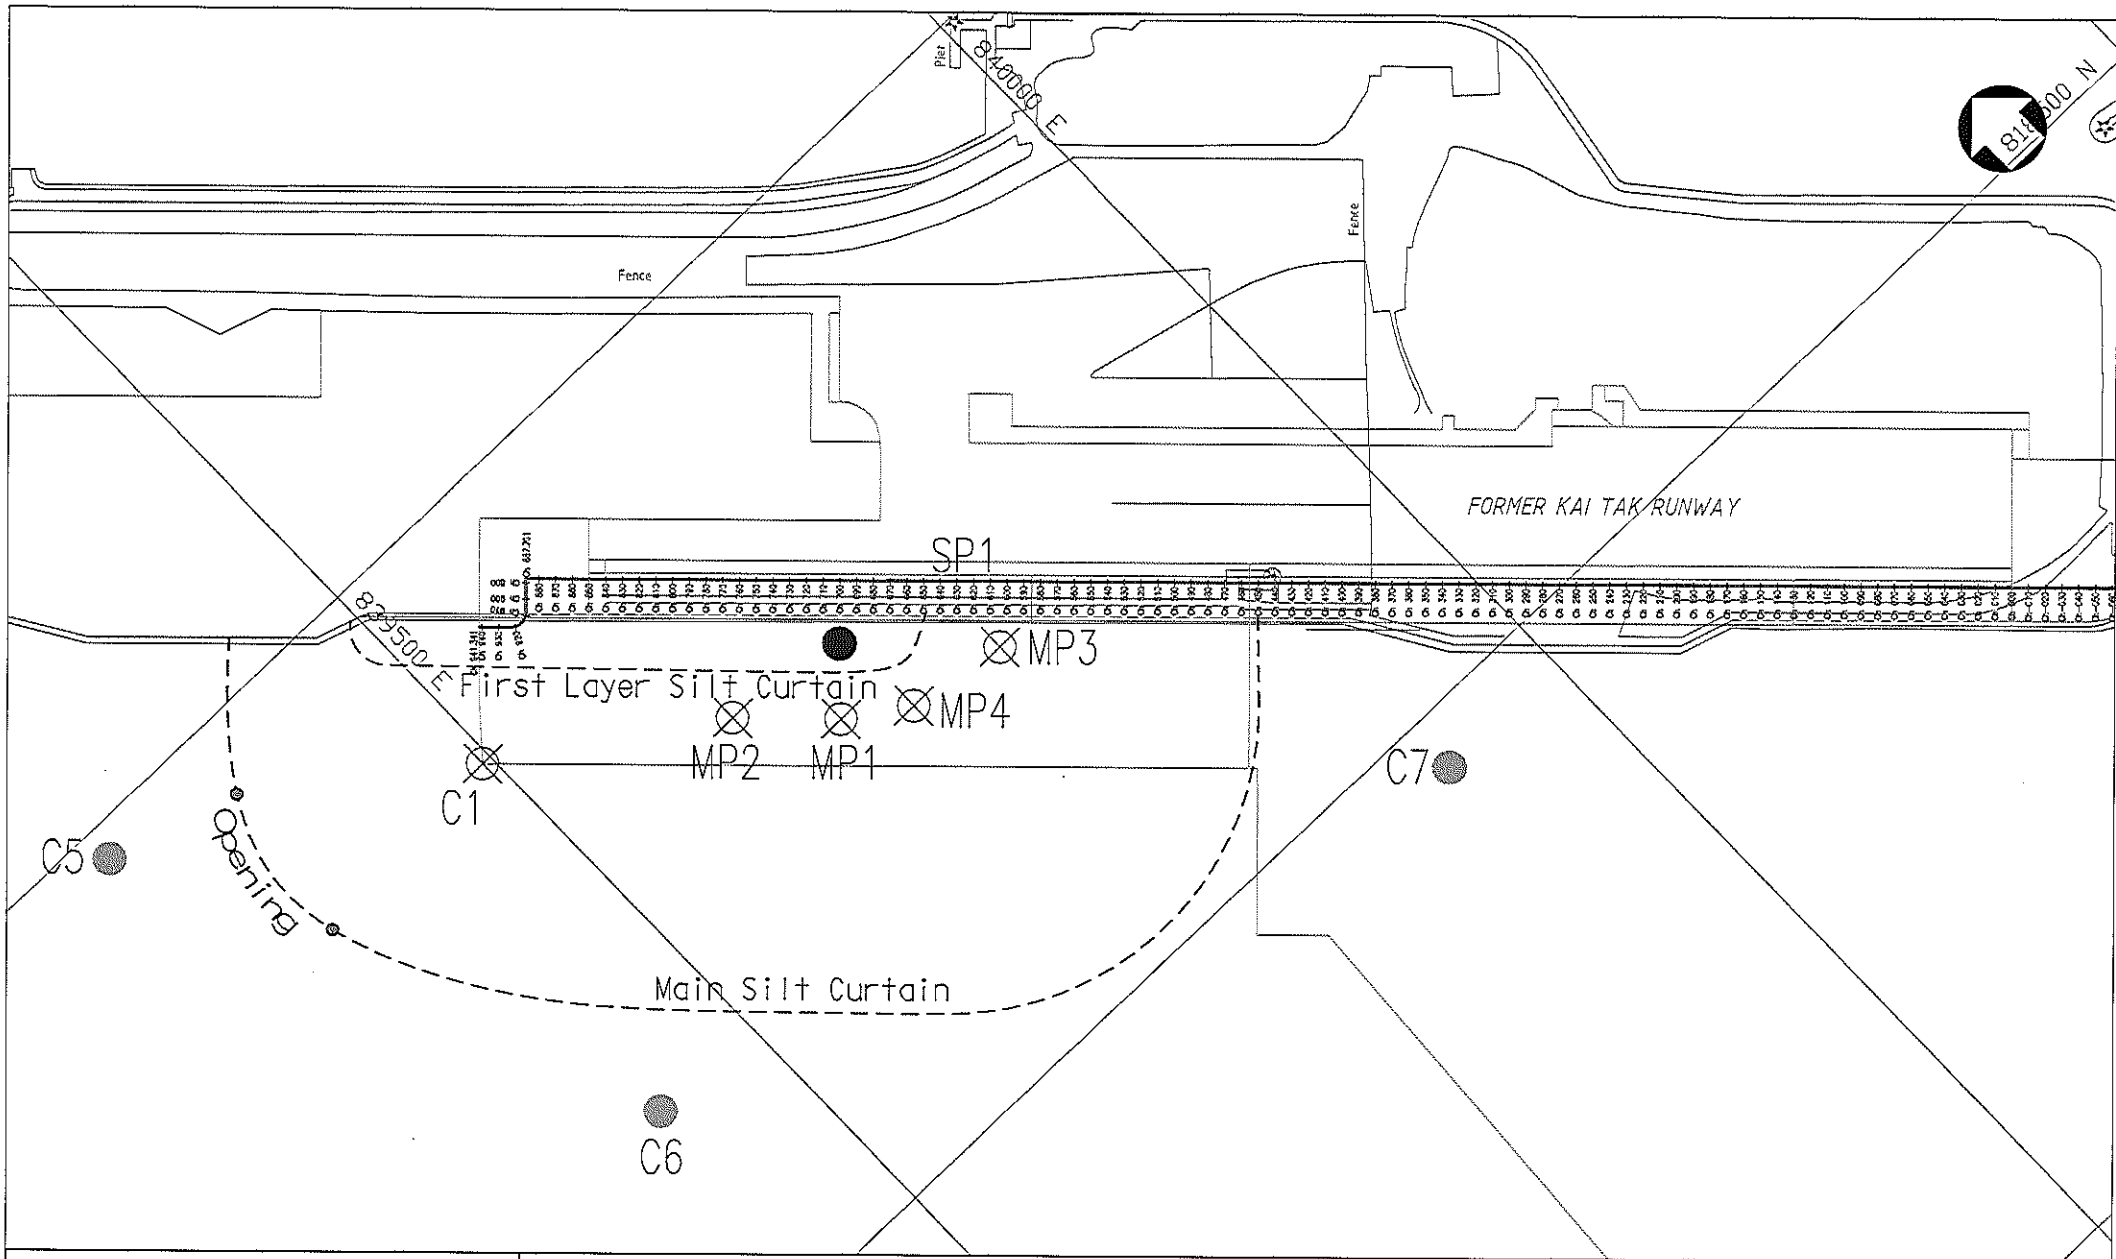

PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**


TITLE  
 Water Quality Surveillance System – 25 Oct 2012

DATE  
 7 Nov 2012

PREPARED BY  
 PH

SCALE  
 NOT TO SCALE

SKETCH No.  
 SK-0942

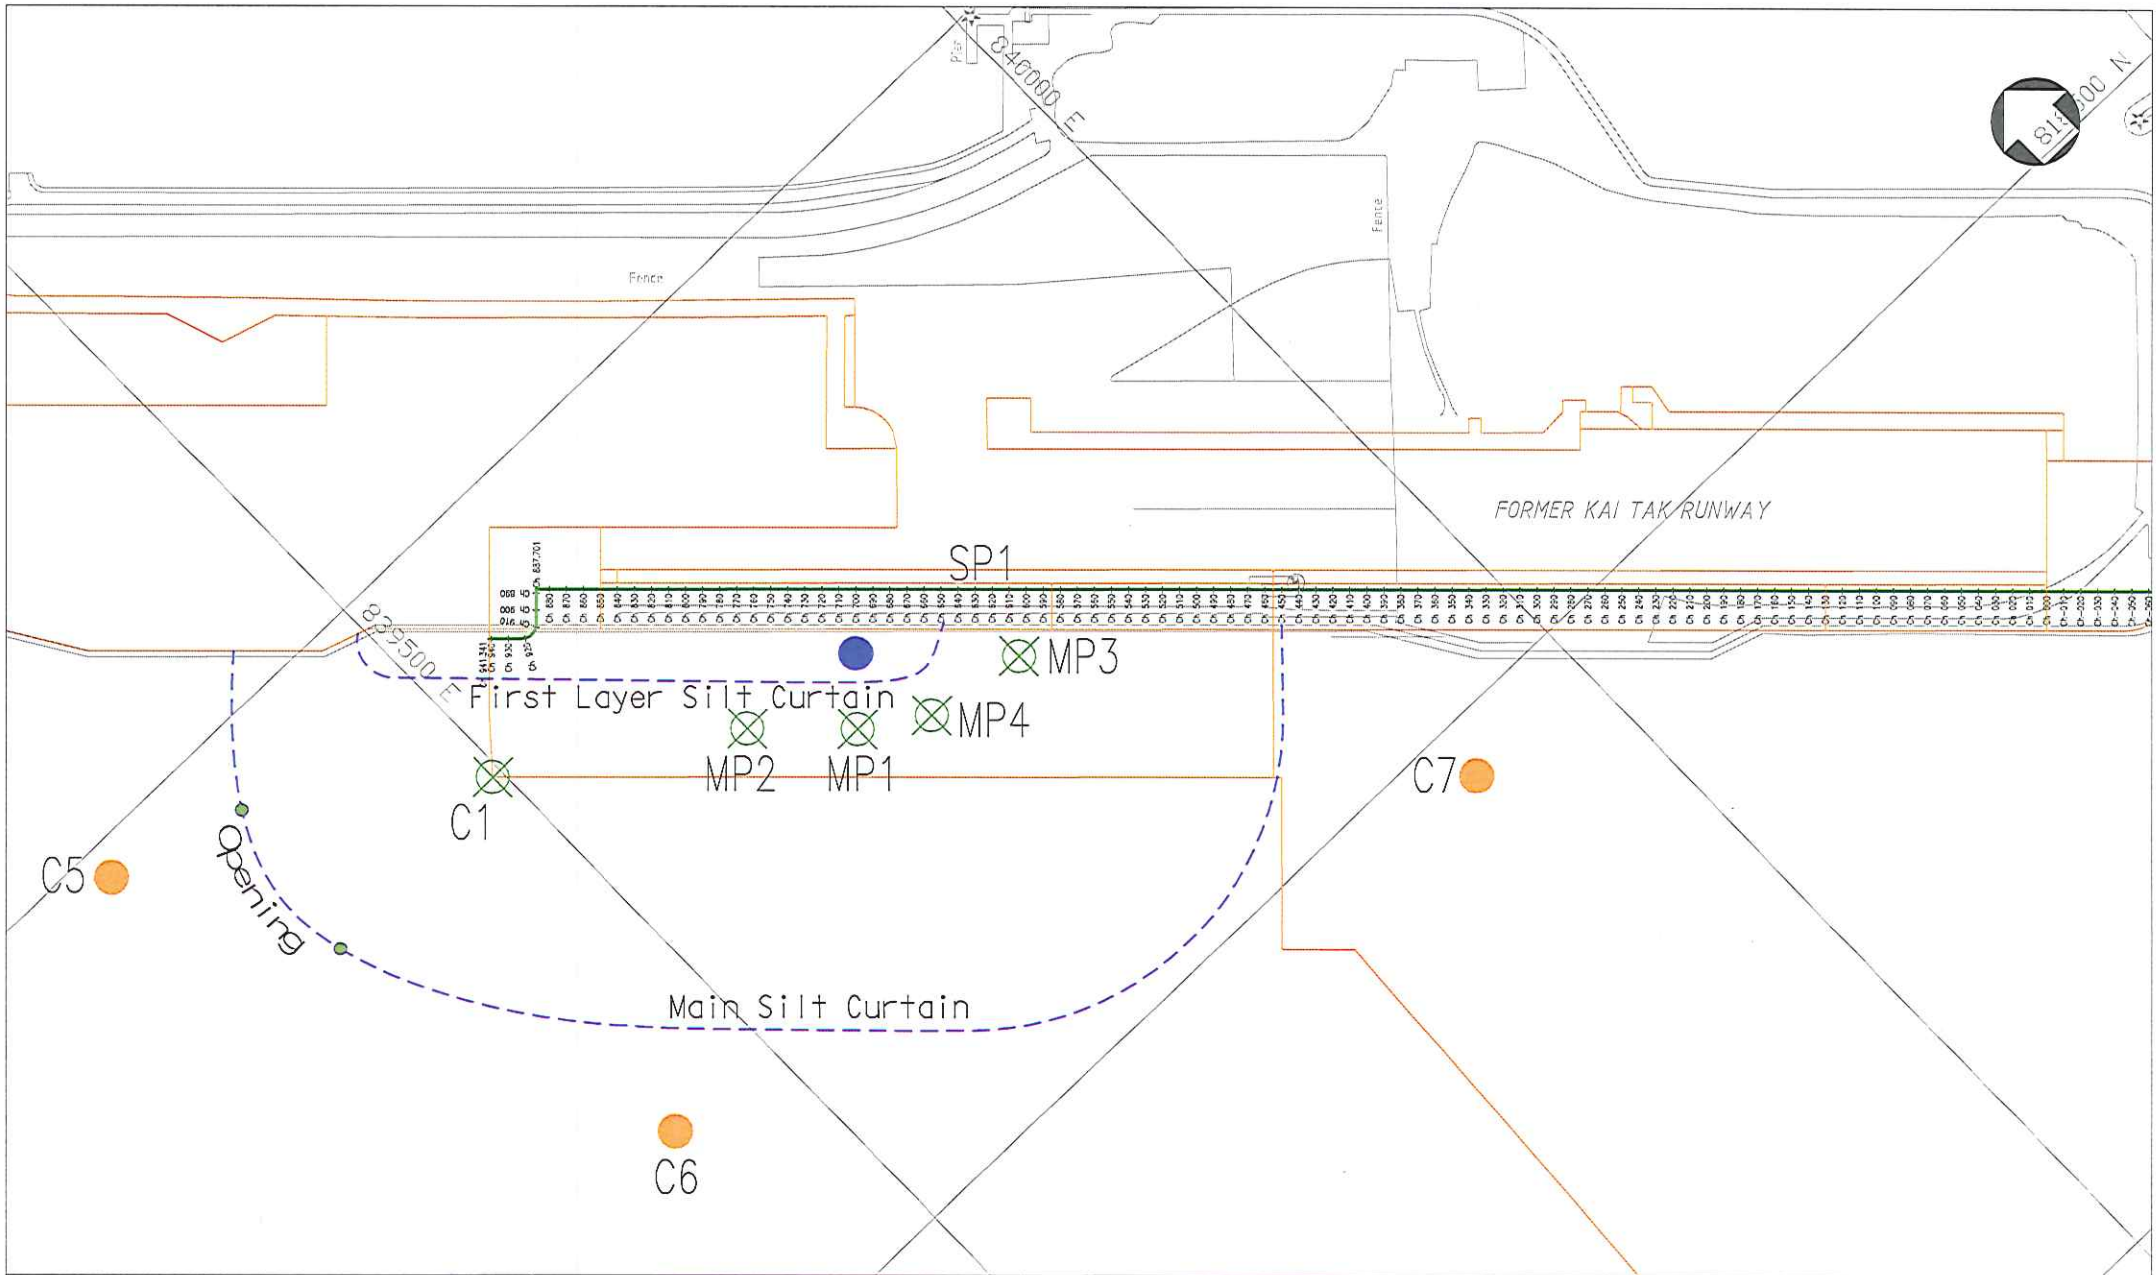

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development


TITLE  
Water Quality Surveillance System – 12 November 2012

DATE  
23 Nov 2012

PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0957

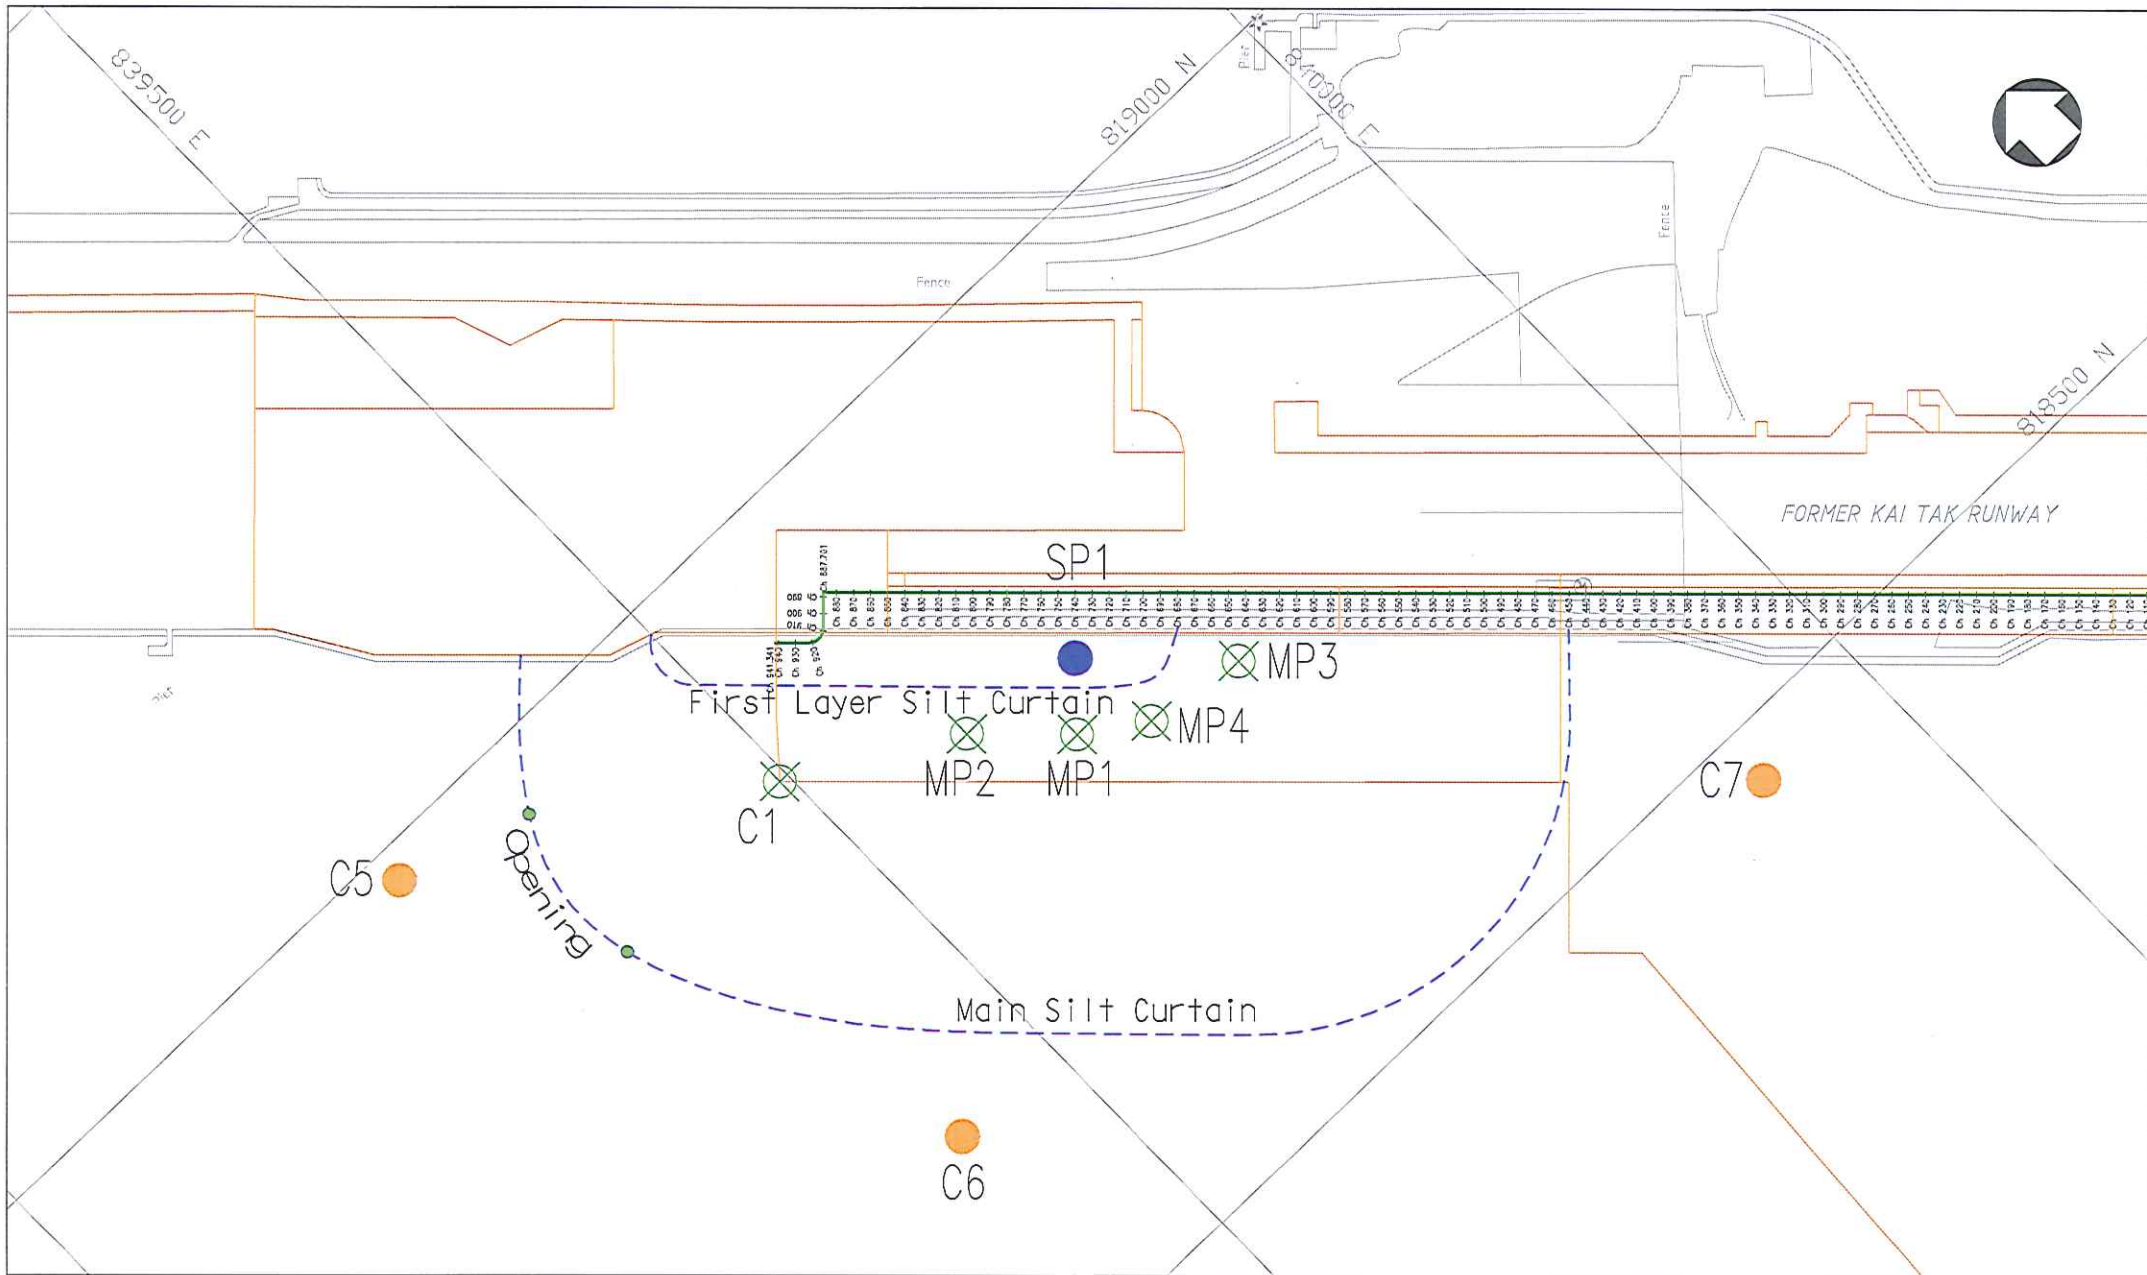

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
Water Quality Surveillance System – 26 November 2012

DATE  
5 Dec 2012

PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0961





***Appendix 2.1***

***Implementation Schedule of Environmental Mitigation Measures***



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S3.6	Requirements of the Air Pollution Control (Construction Dust) Regulation shall be adhered to during the construction period.	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	Air Pollution Control (Construction Dust) Regulation
S3.6	In order to minimize the potential odour emissions, if any, the dredged sediment placed on barge should be properly covered as far as practicable to minimise the exposed area and hence the potential odour emissions during the transportation of the dredged sediment.	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM
S4.8	Good Site Practices: <ul style="list-style-type: none"><li>• Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program.</li><li>• Mobile plant, if any, should be sited as far away from NSRs as possible.</li><li>• Machines and plant (such as trucks) that may be in intermittent use should be shut down between works periods or should be throttled down to a minimum.</li><li>• Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs.</li><li>• Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities.</li></ul>	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	NCO EIAO-TM



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S4.9	If there is any planned NSRs within 300m from the work area occupied during the dredging period, an EM&A programme is recommended to be established according to the predicted occurrence of noisy activities. All the recommended mitigation measures for daytime normal working activities should be incorporated into the EM&A programme for implementation during dredging.	Representative NSRs at the former Kai Tak Airport runway / Upon formal occupation	N/A	Not applicable	NCO EIAO-TM
S5.9	<ul style="list-style-type: none"><li>Dredging will be carried out by closed grab dredger to minimize release of sediment and other contaminants during both capital and maintenance dredging.</li><li>The maximum production rate for dredging from the seabed to provide necessary manoeuvring area would not be more than 4,000m<sup>3</sup> per day (and no more than 2 closed grab dredgers) during capital dredging and 2,000m<sup>3</sup> per day (and no more than 1 closed grab dredger) during maintenance dredging.</li><li>The maximum production rate for dredging at or near the seawall area would not be more than 4,000m<sup>3</sup> per day for berth construction. No more than two closed grab dredger would be operated at the same time at or near the seawall for berth construction.</li></ul>	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM WPCO
S5.9	Silt curtains should be deployed around the closed grab dredgers used for dredging at and near the existing seawall of the former Kai Tak Airport runway for construction of the cruise berth structures.	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM, WPCO



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S5.9	Silt screens should be installed at the WSD flushing water intakes at Cha Kwo Ling, Sai Wan Ho, Quarry Bay, Sheung Wan, Wan Chai and Tai Wan for dredging in the manoeuvring basin of the first berth during the capital dredging.	Seawater intakes in Victoria Harbour/ During the construction of cruise terminal	Contractor for capital dredging	Implemented	EIAO-TM, WPCO
S5.9	Silt screens should be installed at the WSD flushing water intakes at Cha Kwo Ling, Quarry Bay and Tai Wan for dredging in the manoeuvring basin of the second berth during the capital dredging.	Seawater intakes in Victoria Harbour / During the construction of cruise terminal	Contractor for capital dredging	Implemented	EIAO-TM, WPCO
S5.9	If the opening has been introduced at the northern runway, silt screens should also be installed at the WSD flushing water intake at Sai Wan Ho, Sheung Wan and Wan Chai for dredging in the manoeuvring basin of the second berth during the capital dredging.	Seawater intake at Sai Wan Ho, Sheung Wan and Wan Chai / During the construction of cruise terminal	Contractor for capital dredging	Implemented	EIAO-TM, WPCO



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S5.9	<p>Other good site practices that should be undertaken during dredging include:</p> <ul style="list-style-type: none"><li>• all vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash;</li><li>• all barges / dredgers should be fitted with tight fitting seals to their bottom openings to prevent leakage of material;</li><li>• construction activities should not cause foam, oil, grease, scum, litter or other objectionable matter to be present on the water within the site or dumping grounds;</li><li>• barges or hoppers should not be filled to a level that will cause the overflow of materials or polluted water during loading or transportation.</li></ul>	Work site and adjacent waters / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO, EIAO-TM, WPCO, WDO
S5.9	Appropriate numbers of portable chemical toilets shall be provided by a licensed contractor to serve the construction workers over the construction site. The Contractor shall also be responsible for waste disposal and maintenance practices.	Work site and adjacent waters / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM, WPCO, WDO



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref #	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S5.9	Collection and removal of floating refuse should be performed at regular intervals on a daily basis. The contractor should be responsible for keeping the water within the site boundary and the neighbouring water free from rubbish during the dredging works.	Work site and adjacent waters / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM, WPCO, WDO
S5.9	An environmental monitoring and audit programme should be implemented to verify whether or not impact predictions are representative, and to ensure that all the recommended mitigation measures are implemented properly. If the water quality monitoring data indicate that the proposed dredging works result in unacceptable water quality impacts in the receiving water, appropriate actions should be taken to review the dredging operation and additional measures such as use of frame-type silt curtain, deployment of double silt curtains, slowing down, or rescheduling of works should be implemented as necessary.	6 selected WSD flushing water intakes in Victoria Harbour/ During dredging in construction stage	Environmental Team and verified by Independent Environmental Checker	Implemented	EIAO-TM, WPCO



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S5.9	Silt screens are recommended to be deployed at 6 selected WSD flushing water intakes during the capital dredging. The contractor for capital dredging shall demonstrate and ensure that the design of the silt screen will not affect the normal operation of flushing water intake. The contractor shall obtain consensus from all relevant parties, including WSD and Marine Department on the design of the silt screen at each of the six selected flushing water intake points before installation of the silt screen and commencement of the proposed dredging works. As a mitigation measure to avoid the pollutant and refuse entrapment problems and to ensure that the impact monitoring results are representative, regular maintenance of the silt screens and refuse collection should be performed at the monitoring stations at regular intervals on a daily basis. The Contractor should be responsible for keeping the water behind the silt screen free from floating rubbish and debris during the impact monitoring period.	6 selected WSD flushing water intakes in Victoria Harbour/ During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM, WPCO



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S6.7	<p>Good Site Practices</p> <p>It is not anticipated that adverse waste management related impacts would arise, provided that good site practices are adhered to. Recommendations for good site practices during the dredging activities include:</p> <ul style="list-style-type: none"><li>• Nomination of an approved person, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.</li><li>• Training of site personnel in proper waste management and chemical waste handling procedures.</li><li>• Provision of sufficient waste disposal points and regular collection for disposal.</li><li>• Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.</li><li>• A recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites).</li><li>• Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li></ul>	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM





IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S6.7 (cont.)	<ul style="list-style-type: none"><li>Encourage collection of aluminium cans, PET bottles and paper by providing separate labelled bins to enable these wastes to be segregated from other general refuse generated by the workforce.</li><li>Any unused chemicals or those with remaining functional capacity shall be recycled.</li></ul>	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	EIAO-TM
S6.7	<p>Marine Sediments</p> <p>The dredged marine sediments would be loaded onto barges and transported to the designated disposal sites allocated by the MFC depending on their level of contamination. Sediment classified as Category L would be suitable for Type 1 – Open Sea Disposal. Contaminated sediment would require either Type 1 – Open Sea Disposal (Dedicated Sites) or Type 2 - Confined Marine Disposal and must be dredged and transported with great care in accordance with ETWB TCW No. 34/2002. Subject to the final allocation of the disposal sites by MFC, the dredged contaminated sediment must be effectively isolated from the environment upon final disposal and shall be disposed of at the East Sha Chau Contaminated Mud Pits that are designated for the disposal of contaminated mud in Hong Kong.</p>	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	ETWB TCW No. 34/2002



EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S6.7	It will be the responsibility of the Contractor to satisfy the appropriate authorities that the contamination levels of the marine sediment to be dredged have been analysed and recorded. According to the ETWB TCW No. 34/2002, this will involve the submission of a formal Sediment Quality Report to the DEP, prior to the dredging contract being tendered. The contractor for the dredging works shall apply for the allocation of marine sediment disposal sites from all relevant authorities.	Work site / During dredging in construction stage	Contractor for capital dredging	Dumping Permits were issued by EPD	ETWB TCW No. 34/2002
S6.7	During transportation and disposal of the dredged marine sediments requiring Type 1 and Type 2 disposal, the following measures shall be taken to minimise potential impacts on water quality: <ul style="list-style-type: none"><li>• Bottom opening of barges shall be fitted with tight fitting seals to prevent leakage of material. Excess material shall be cleaned from the decks and exposed fittings of barges and hopper dredgers before the vessel is moved.</li><li>• Monitoring of the barge loading shall be conducted to ensure that loss of material does not take place during transportation. Transport barges or vessels shall be equipped with automatic self-monitoring devices as specified by the DEP.</li><li>• Barges or hopper barges shall not be filled to a level that would cause the overflow of materials or sediment laden water during loading or transportation.</li></ul>	Work site / During dredging in construction stage	Contractor for capital dredging	Implemented	WDO; WPCO



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S6.7	<p>Chemical Wastes</p> <p>After use, chemical wastes (for example, cleaning fluids, solvents, lubrication oil and fuel) should be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Spent chemicals should be collected by a licensed collector for disposal at the CWTF or other licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</p>	<p>Work site / During dredging in construction stage</p>	<p>Contractor for capital dredging</p>	<p>Implemented</p>	<p>Waste Disposal (Chemical Waste) (General) Regulation; Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes</p>
S6.7	<p>General Refuse</p> <p>General refuse should be stored in enclosed bins or compaction units separate from C&amp;D material. A reputable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&amp;D material. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material.</p>	<p>Work site / During dredging in construction stage</p>	<p>Contractor for capital dredging</p>	<p>Implemented</p>	<p>WDO, WPCO</p>



EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S6.7	<p>Construction and Demolition Material</p> <p>It is recommended that the extent of dredging of the existing seawall should be kept to a minimum in the detailed design of the new cruise terminal to minimize generation of C&amp;D material. Mitigation measures and good site practices should be incorporated in the contract document to control potential environmental impact from handling and transportation of C&amp;D material. The mitigation measures include:</p> <ul style="list-style-type: none"><li>• Where it is unavoidable to have transient stockpiles of C&amp;D material within the Project work site pending collection for disposal, the transient stockpiles shall be located away from waterfront or storm drains as far as possible.</li><li>• Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric.</li><li>• Skip hoist for material transport should be totally enclosed by impervious sheeting.</li><li>• Every vehicle should be washed to remove any dusty materials from its body and wheels before leaving a construction site.</li><li>• The area where vehicle washing takes place and the section of the road between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores.</li></ul>	Work site / During the construction period	Contractor for capital dredging	Implemented	ETWB TCW No. 33/2002, 31/2004, 19/2005



EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S6.7 (cont.)	<ul style="list-style-type: none"><li>• The load of dusty materials carried by vehicle leaving a construction site should be covered entirely by clean impervious sheeting to ensure dust materials do not leak from the vehicle.</li><li>• All dusty materials should be sprayed with water prior to any loading, unloading or transfer operation so as to maintain the dusty materials wet.</li><li>• The height from which excavated materials are dropped should be controlled to a minimum practical height to limit fugitive dust generation from unloading.</li></ul>	Work site / During the construction period	Contractor for capital dredging	Implemented	ETWB TCW No. 33/2002, 31/2004, 19/2005
S6.7	When delivering inert C&D material to public fill reception facilities, the material shall consist entirely of inert construction waste and of size less than 250mm or other sizes as agreed with the Secretary of the Public Fill Committee. In order to monitor the disposal of the surplus C&D material at the designed public fill reception facility and to control fly tipping, a trip-ticket system should be included as one of the contractual requirements and implemented by the Contractor under the Waste Management Plan certified by the Environmental Team and verified by the Independent Environmental Checker who should be responsible for auditing the results of the system.	Work site / During the construction period	Contractor for capital dredging, Engineer, Environmental Team and Independent Environmental Checker	Not applicable	ETWB TCW No. 31/2004



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S7.8	The dredging activities of the proposed cruise terminal should ensure that disturbance to the existing seawall masonry outside the Project boundary should be avoided as far as practicable.	Work site/ During construction of cruise terminal	Contractor for capital dredging as per CEDD's advice	Implemented	Antiquities and Monuments Ordinance EIAO, EIAO-TM Guidance Notes on Assessment of Impact on Sites of Cultural Heritage in Environmental Impact Assessment Studies (GN-CH) Hong Kong Planning Standards and Guidelines (HKPSG)
S7.10, App. 7.1	It is recommended that the dredged spoil should be monitored for the presence of archaeological material.  Guidelines for the monitoring brief have been prepared in consultation with the AMO. A qualified marine archaeologist needs to be on standby to provide specialist advice, if required, but the monitoring can be carried out by a member of staff on the dredging barge.	Work site / during dredging in construction stage	Contractor for capital dredging, Environmental Team	Implemented	Antiquities and Monuments Ordinance EIAO, EIAO-TM GN-CH HKPSG Marine Archaeological Investigation Guidelines



EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
8.7	<p>Translocate those existing coral colonies attached on boulders that are manually movable by a diver underwater (possibly longest dimension of less than 50cm) located within the hard substrata sea area within the dredging site as far as practicable prior to the commencement of the capital dredging activities. The entire translocation exercise include the preparation of a detailed translocation plan, the pre-translocation coral survey, the coral translocation, and the quarterly post-translocation monitoring for one year. Pre-translocation survey would be focused on identifying and mapping of coral colonies that would be directly impacted by the proposed dredging and investigating the translocation feasibility of these coral colonies. A detailed translocation plan (including pre-translocation coral survey, translocation methodology and monitoring of transplanted corals) should be prepared during the detailed design stage of the Project which, together with the ecologist involved in coral translocation, should be approved by AFCD prior to commencement of the translocation exercises. The proposed relocation of the coral colonies should not affect any private/public marine rights at the recipient site.</p>	<p>Along the section of the former Kai Tak Airport runway that will be directed affected by the cruise terminal construction / During detailed design stage</p>	<p>Other ET specifically employed for coral translocation works</p>	<p>Final Detailed Coral Translocation Plan was approved by EPD in letter ref. (18) in EP2/K19/C/19 Pt.5 dated 5 June 2009.</p> <p>Form 5 was submitted under CEDD's memo ref. (6) in KD 2/31/4 Pt.3 dated 10 June 2009 regarding minor alteration of the position of the coral recipient site.</p> <p>Coral Translocation Report was submitted in Scott Wilson letter ref. 08290/325723 dated 2 July 2009.</p> <p>Post-translocation report shall be referred to the submissions by another ET specifically employed for coral translocation works.</p>	<p>EIAO-TM</p>



IMPLEMENTATION SCHEDULE OF ENVIRONMENTAL MITIGATION MEASURES

EIA Ref#	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Status	Relevant Legislation and Guidelines
S8.7	New seawalls at the berth structure of the cruise terminal shall be constructed in order to provide large area of hard substrata for settlement and recruitment of intertidal and subtidal assemblages similar to those previously recorded from existing habitats.	The section of the former Kai Tak Airport runway that will be directed affected by the cruise terminal construction / During detailed design stage	To be confirmed at later stage	To be confirmed at later stage	EIAO-TM
9.6	No fisheries-specific mitigation measures would be required.	-	Not applicable	Not applicable	-





***Appendix 3.1***

***Action and Limit Levels***



**Action and Limit Levels**

*Action and Limit Levels for Noise Monitoring*

Time Period	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received from any one of the sensitive receivers	75 dB(A)

Remarks: No noise monitoring was conducted due to no planned noise sensitive receivers (NSRs) occupied within 300m from the works area of this Project during the dredging works.

*Action and Limit Levels for Water Monitoring*

Parameters	Action Level			Limit Level		
Turbidity in NTU	<u>All Season</u>			<u>All Season</u>		
	WSD9	5.67		WSD9	12.27	
	WSD10	6.26		WSD10	10.47	
	WSD15	8.15		WSD15	14.41	
	WSD17	11.60		WSD17	16.91	
	WSD21	9.11		WSD21	15.38	
	WSD19	13.09		WSD19	15.34	
Suspended Solids (SS) in mg/L	<u>Dry Season</u>		<u>Wet Season</u>	<u>Dry Season</u>		<u>Wet Season</u>
	WSD9	6.9	9.7	WSD9	7.8	10.9
	WSD10	7.7	9.1	WSD10	10.3	12.2
	WSD15	7.8	13.5	WSD15	8.4	14.5
	WSD17	9.5	11.2	WSD17	13.7	16.2
	WSD21	13.3	17.1	WSD21	13.9	17.8
	WSD19	16.3	15.1	WSD19	17.0	15.7

Remarks:  
 Wet season is the period from April to September.  
 Dry season is the period from October to March.

*Revised Action and Limit Levels for Water Monitoring*

Station	Turbidity (NTU)				Suspended Solid (mg/L)			
	Action Level for individual stations		Limit Level for individual stations		Action Level for individual stations		Limit Level for individual stations	
	Dry Season	Wet Season	Dry Season	Wet Season	Dry Season	Wet Season	Dry Season	Wet Season
WSD9	5.6	7.0	10.6	13.4	10.2	12.8	10.8	13.5
WSD10	6.3	8.1	9.4	12.1	10.0	11.2	11.8	13.2
WSD15	7.5	11.9	12.5	19.6	10.8	17.5	11.8	19.1



Station	Turbidity (NTU)				Suspended Solid (mg/L)			
	Action Level for individual stations		Limit Level for individual stations		Action Level for individual stations		Limit Level for individual stations	
	Dry Season	Wet Season	Dry Season	Wet Season	Dry Season	Wet Season	Dry Season	Wet Season
WSD17	10.0	12.9	15.3	19.7	13.2	14.7	15.3	17.0
WSD19	10.9	13.7	14.7	18.4	14.0	13.3	17.0	16.2
WSD21	8.9	11.6	13.4	17.6	13.3	16.7	14.0	17.5

Remarks:

Revised Action and Limit Levels for water monitoring was approved on 19 October 2011.





***Appendix 4.1***

***Graphical Presentation of Water Quality Monitoring Results***

Contract no. KL/2009/01  
Site Formation for Kai Tak Cruise Terminal Development  
Summary of WQM Cancellation in Reporting Quarter

Date	Tide	Reason for Cancellation
24-Sep-12	Mid-flood	Hoisting of Amber Rainstorm Warning

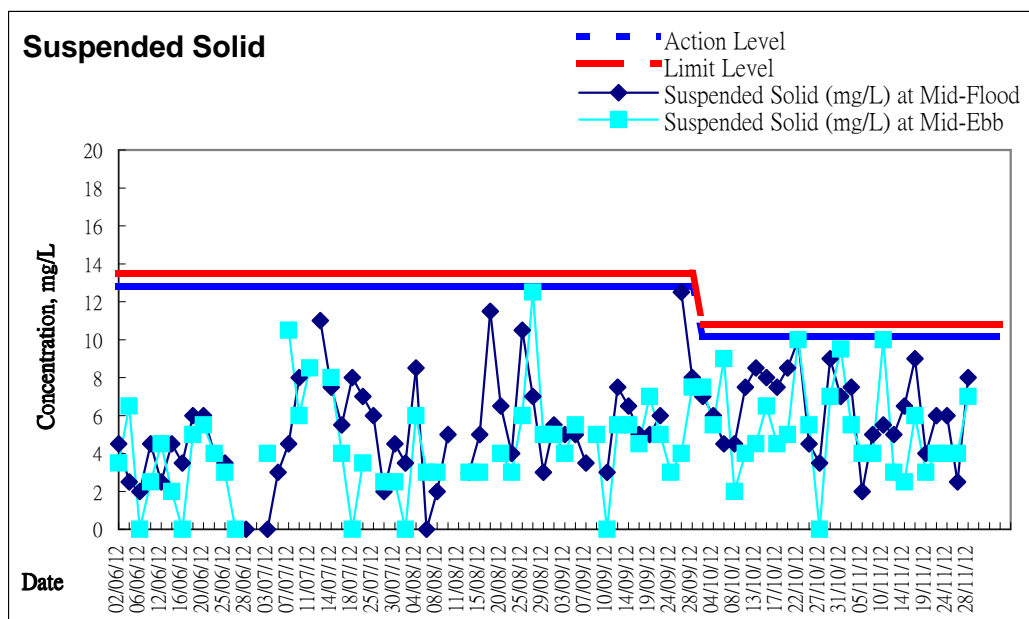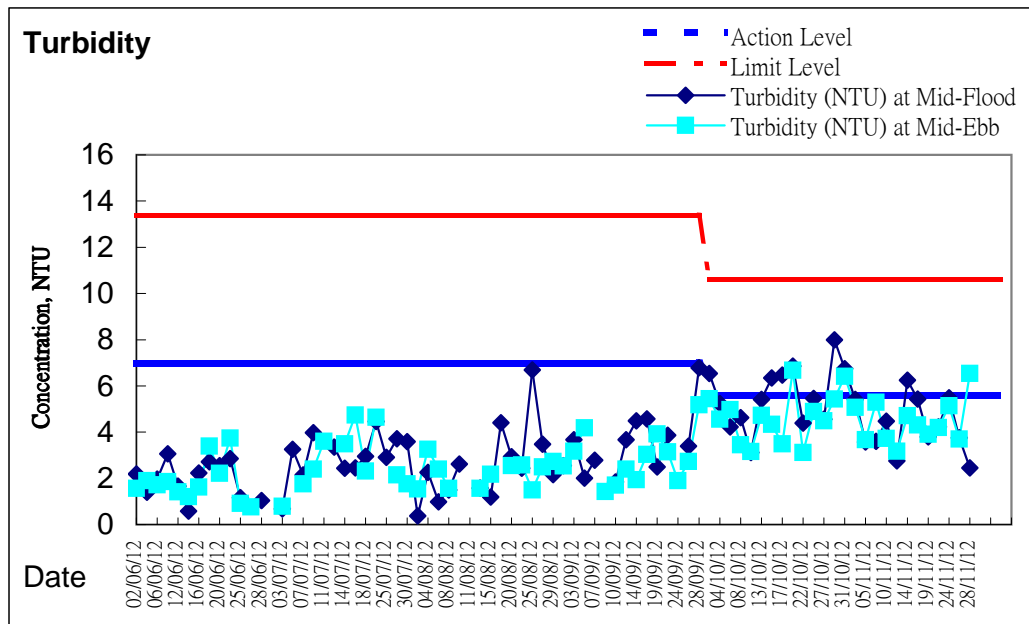



**Remarks:**

- Two sets of Suspended Solid Action and Limit levels for the dry season (the period from October to March) and wet season (the period from April to September).
- New sets Turbidity and SS Action Level and Limit Level for dry and wet season were approved by EPD on 19 Oct 2011







**Graphic Presentation of Water Quality Result of WSD10 - Cha Kwo Ling**

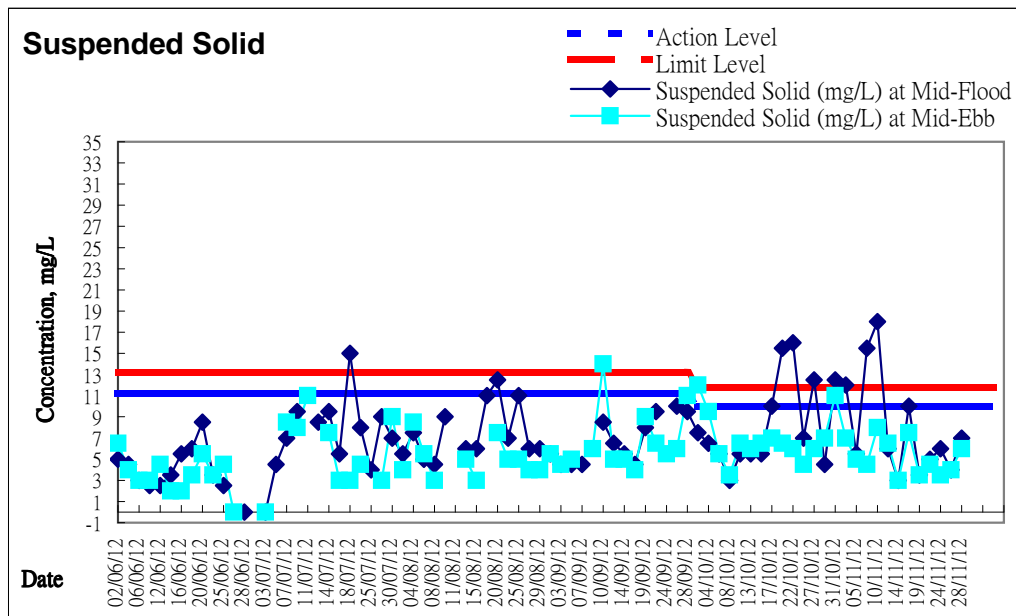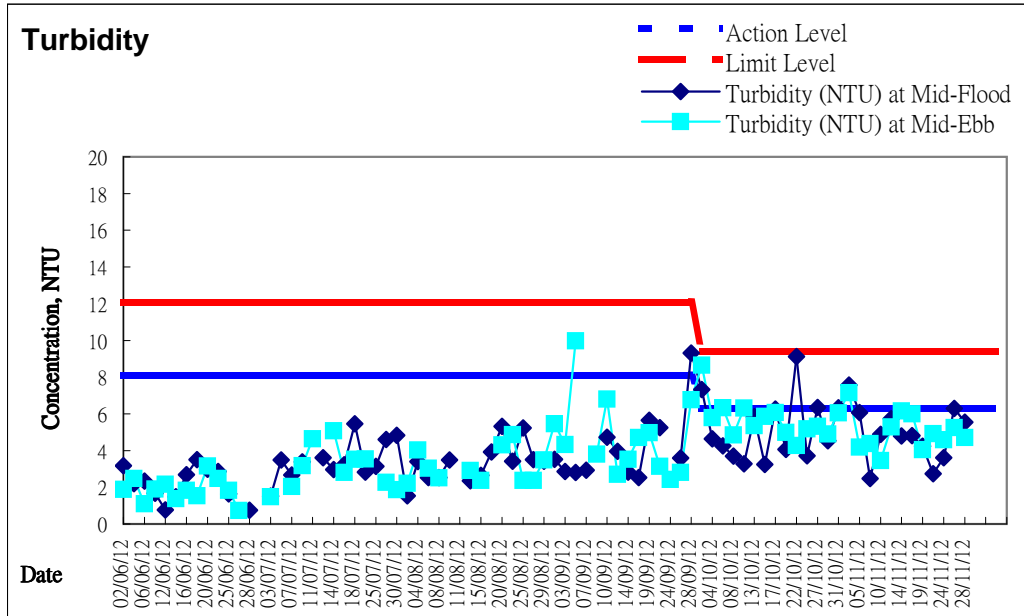

**Remarks:**

- Two sets of Suspended Solid Action and Limit levels for the dry season (the period from October to March) and wet season (the period from April to September).
- New sets Turbidity and SS Action Level and Limit Level for dry and wet season were approved by EPD on 19 Oct 2011

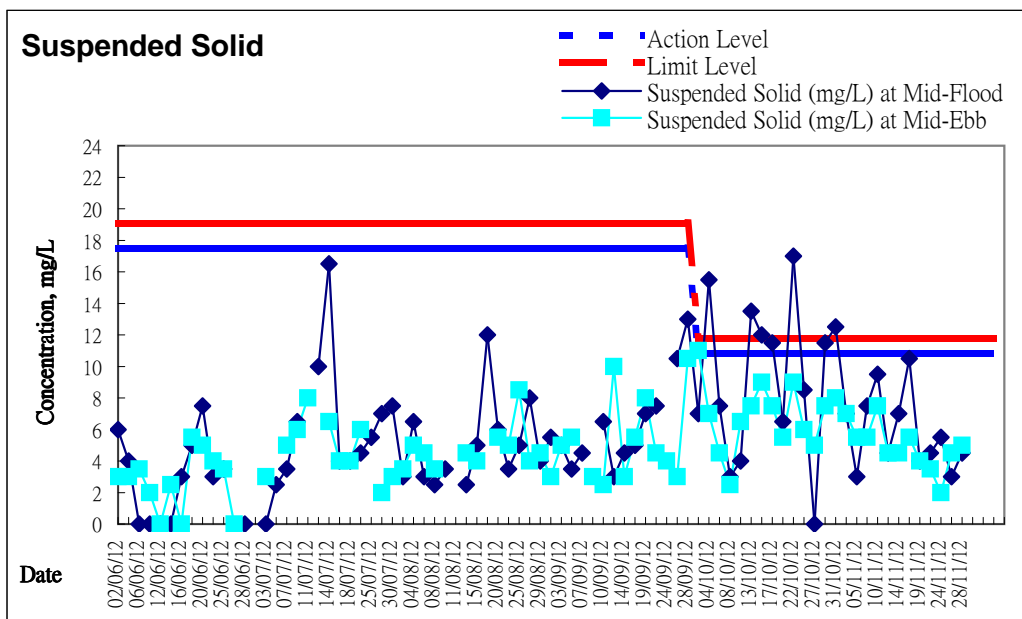
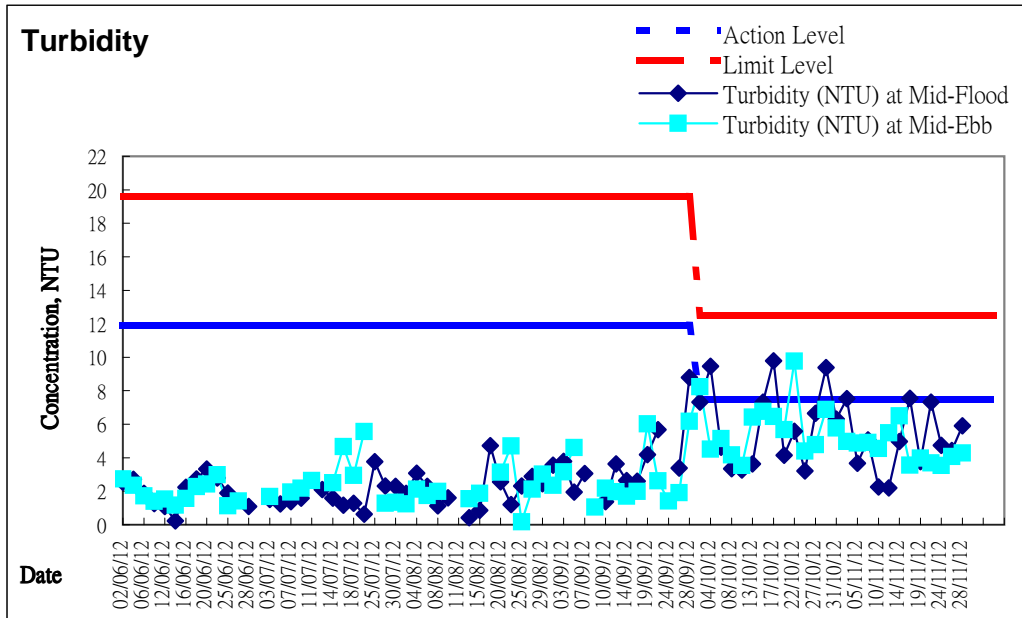


Remarks:

- Two sets of Suspended Solid Action and Limit levels for the dry season (the period from October to March) and wet season (the period from April to September).
- New sets Turbidity and SS Action Level and Limit Level for dry and wet season were approved by EPD on 19 Oct 2011





**Graphic Presentation of Water Quality Result of WSD17 - Quarry Bay**

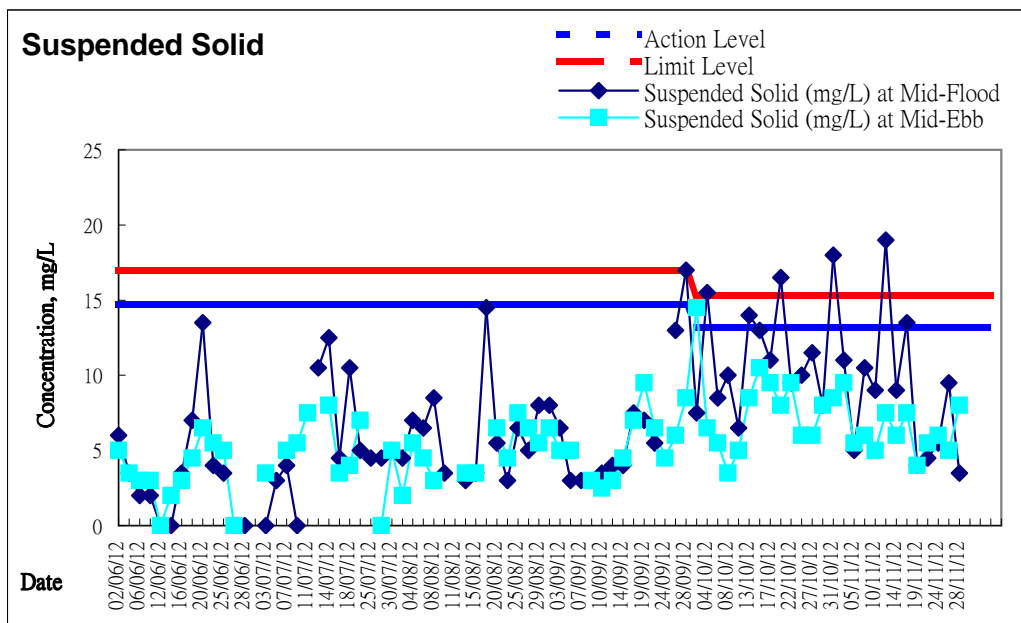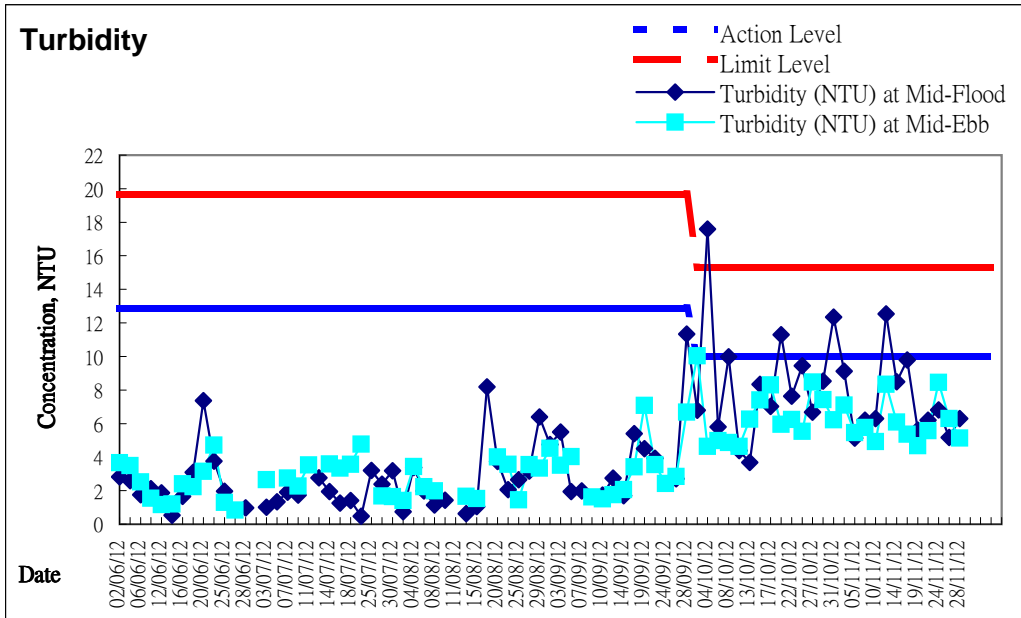



**Remarks:**

- Two sets of Suspended Solid Action and Limit levels for the dry season (the period from October to March) and wet season (the period from April to September).
- New sets Turbidity and SS Action Level and Limit Level for dry and wet season were approved by EPD on 19 Oct 2011

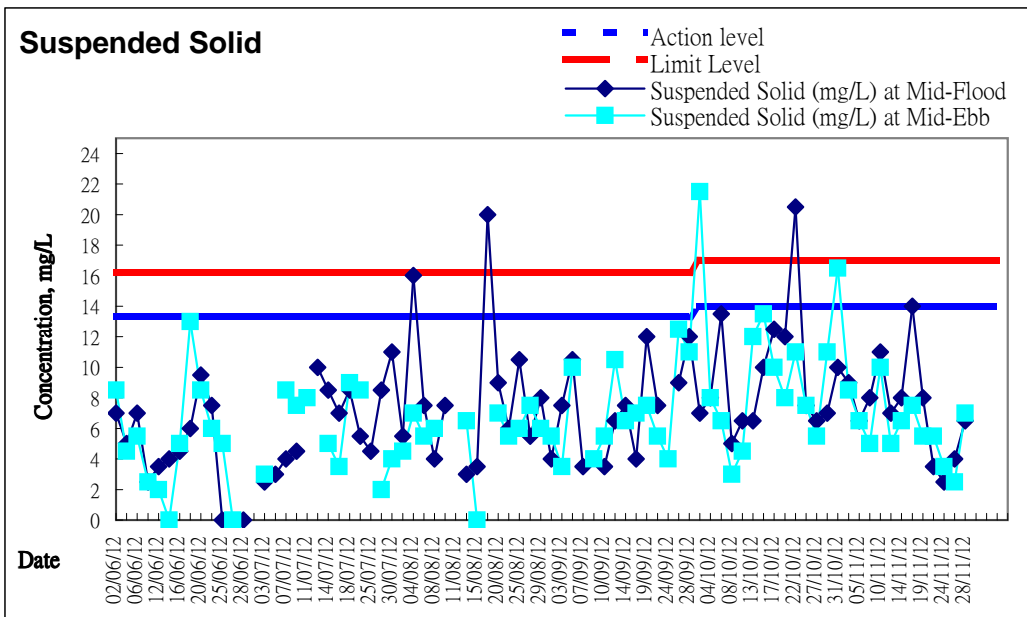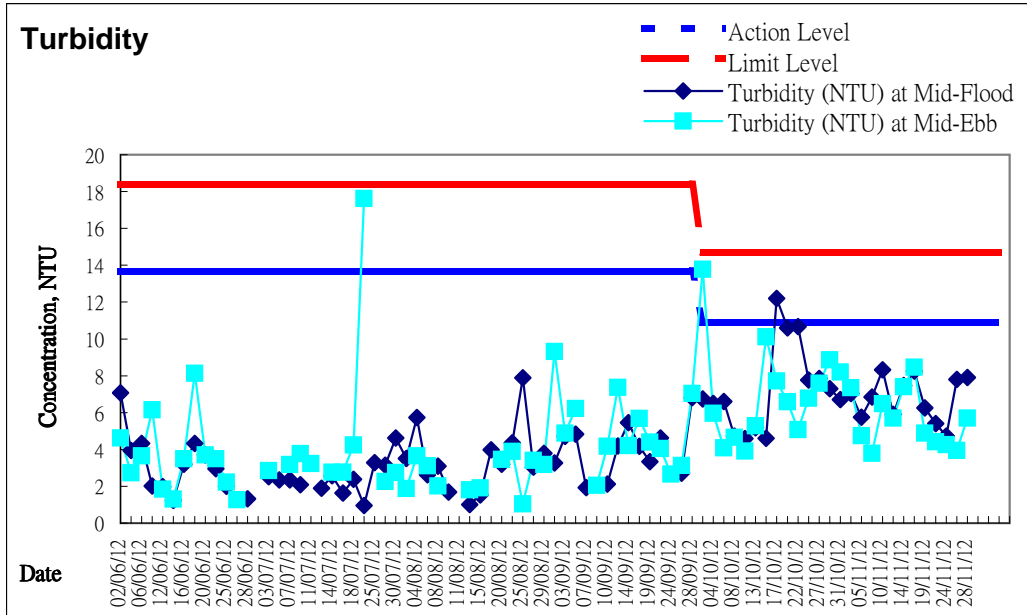

Remarks:

- Two sets of Suspended Solid Action and Limit levels for the dry season (the period from October to March) and wet season (the period from April to September).
- New sets Turbidity and SS Action Level and Limit Level for dry and wet season were approved by EPD on 19 Oct 2011

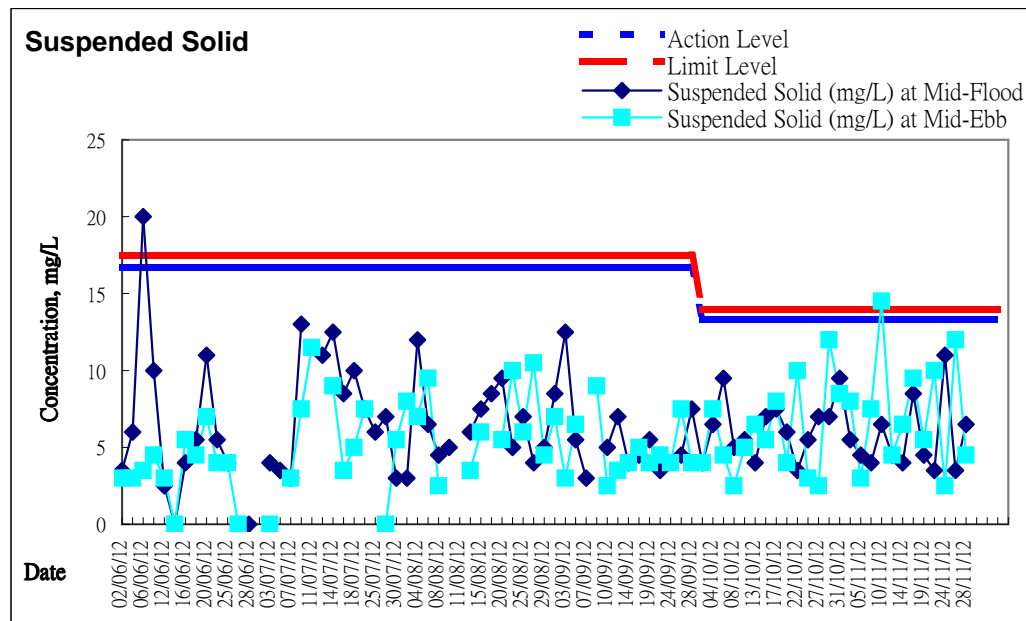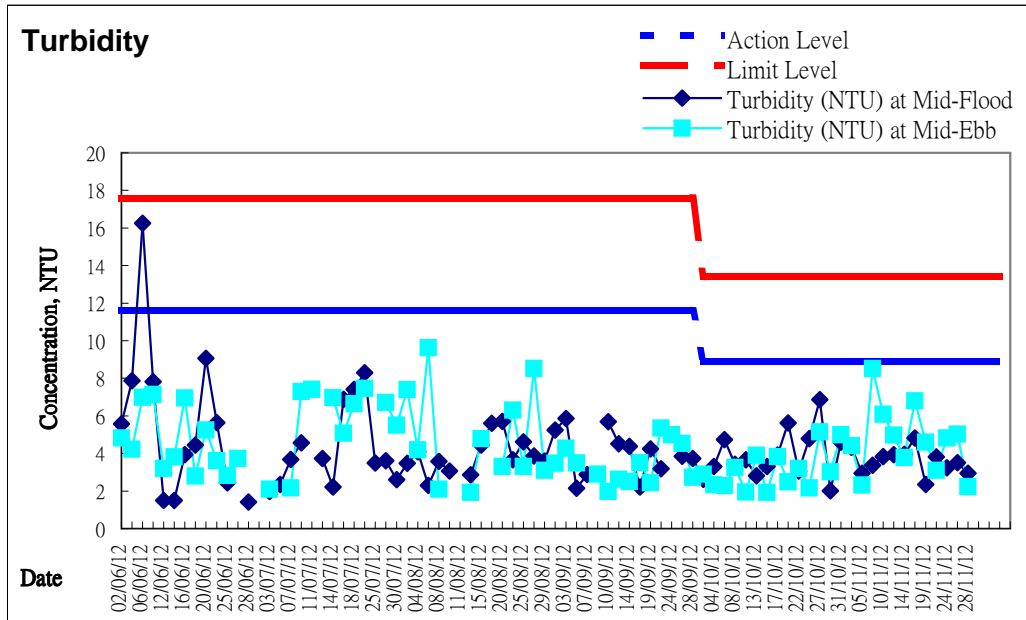

Remarks:

- Two sets of Suspended Solid Action and Limit levels for the dry season (the period from October to March) and wet season (the period from April to September).
- New sets Turbidity and SS Action Level and Limit Level for dry and wet season were approved by EPD on 19 Oct 2011



*Appendix 4.2*


*Graphical Presentation of Water Quality Surveillance*

Water Quality Surveillance System Monitoring Results - 03 September 2012 (Ebb Tide)

Monitoring Location		Turbidity in NTU	Compare to Trigger Level	Suspended Solids in mg/L	Compare to Trigger Level
SP1	1m below the surface	7.41	N/A	12	N/A
	mid depth	6.53	N/A	12	N/A
	1m above the seabed	2.79	N/A	5	N/A
MP1	1m below the surface	2.20	N/A	4	N/A
	mid depth	2.38	N/A	4	N/A
	1m above the seabed	2.28	N/A	6	N/A
MP2	1m below the surface	2.48	N/A	5	N/A
	mid depth	2.29	N/A	5	N/A
	1m above the seabed	2.85	N/A	6	N/A
MP3	1m below the surface	2.00	N/A	4	N/A
	mid depth	1.49	N/A	4	N/A
	1m above the seabed	2.01	N/A	4	N/A
MP4	1m below the surface	2.35	N/A	5	N/A
	mid depth	2.25	N/A	6	N/A
	1m above the seabed	2.69	N/A	4	N/A
C1	1m below the surface	2.45	<b>Lower</b>	4	<b>Lower</b>
	mid depth	2.15	<b>Lower</b>	6	<b>Lower</b>
	1m above the seabed	2.39	<b>Lower</b>	4	<b>Lower</b>
C2	1m below the surface	2.80	<b>Lower</b>	5	<b>Lower</b>
	mid depth	2.43	<b>Lower</b>	4	<b>Lower</b>
	1m above the seabed	3.16	<b>Lower</b>	6	<b>Lower</b>
C3	1m below the surface	4.34	<b>Lower</b>	6	<b>Lower</b>
	mid depth	3.97	<b>Lower</b>	7	<b>Lower</b>
	1m above the seabed	2.67	<b>Lower</b>	8	<b>Lower</b>
C4	1m below the surface	3.83	<b>Lower</b>	6	<b>Lower</b>
	mid depth	4.05	<b>Lower</b>	7	<b>Lower</b>
	1m above the seabed	3.45	<b>Lower</b>	8	<b>Lower</b>
C5	1m below the surface	1.70	N/A	7	N/A
	mid depth	2.25	N/A	4	N/A
	1m above the seabed	2.54	N/A	4	N/A
C6	1m below the surface	1.98	N/A	4	N/A
	mid depth	1.98	N/A	4	N/A
	1m above the seabed	2.24	N/A	5	N/A
C7	1m below the surface	2.95	N/A	5	N/A
	mid depth	2.77	N/A	5	N/A
	1m above the seabed	3.11	N/A	6	N/A

Control Point	Trigger Level for Turbidity in NTU for All Season	Trigger Level for SS in mg/L for Wet Season (April - September)
C1	12.3 for Flood Tide	18.5
C2	12.3 for Flood Tide	
C3	16.9	
C4	10.5 for Ebb Tide	



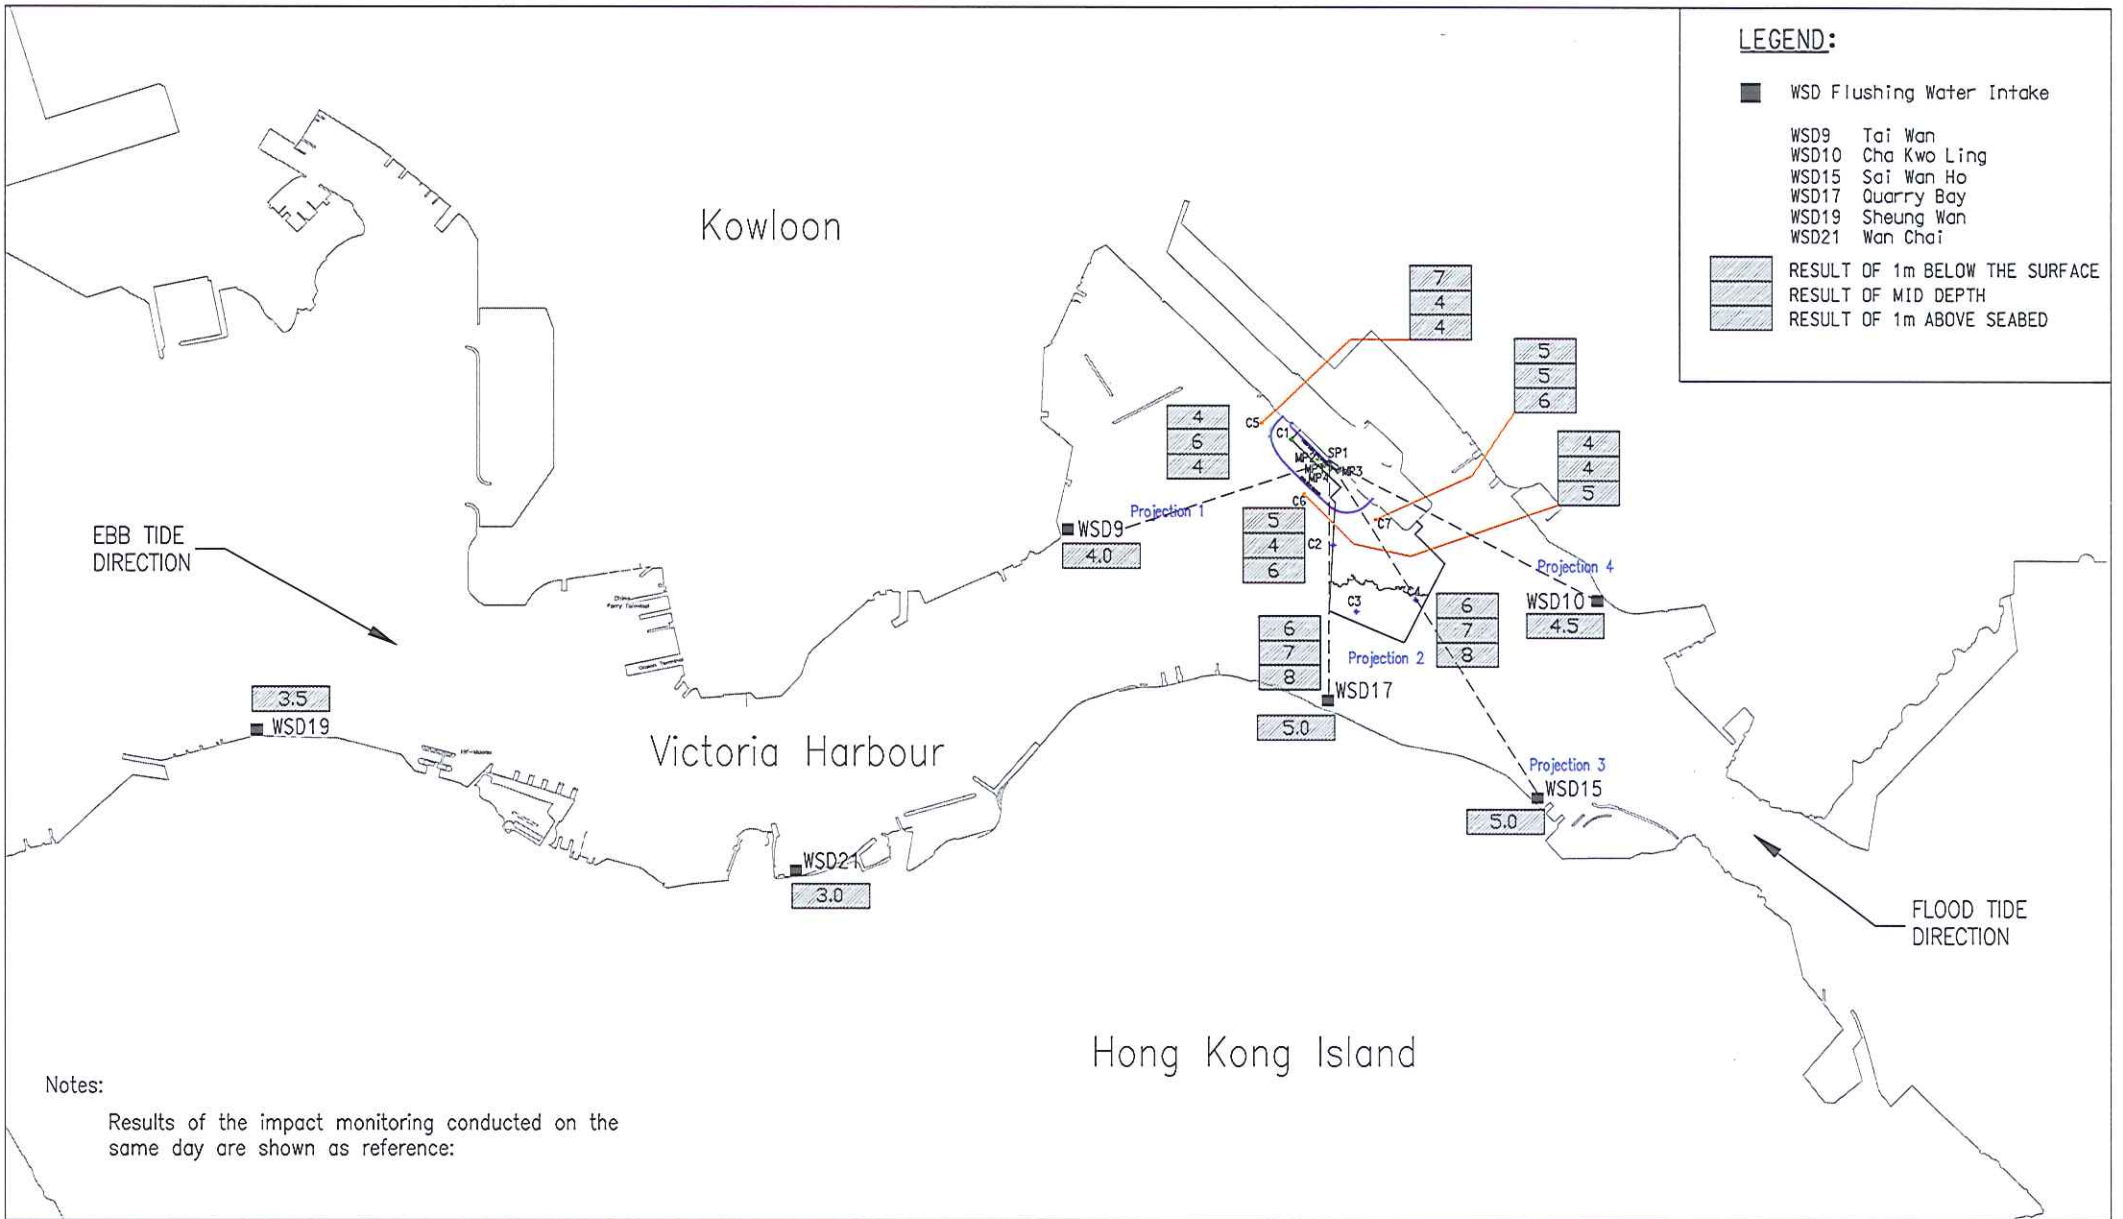


Notes:  
Results of the impact monitoring conducted on the same day are shown as reference:



PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
WATER QUALITY SURVEILLANCE SYSTEM - (3 Sep 2012 Ebb) - Page 1

DATE 17 Sep 2012	PREPARED BY HP
SCALE NOT TO SCALE	SKETCH No. SK-0880

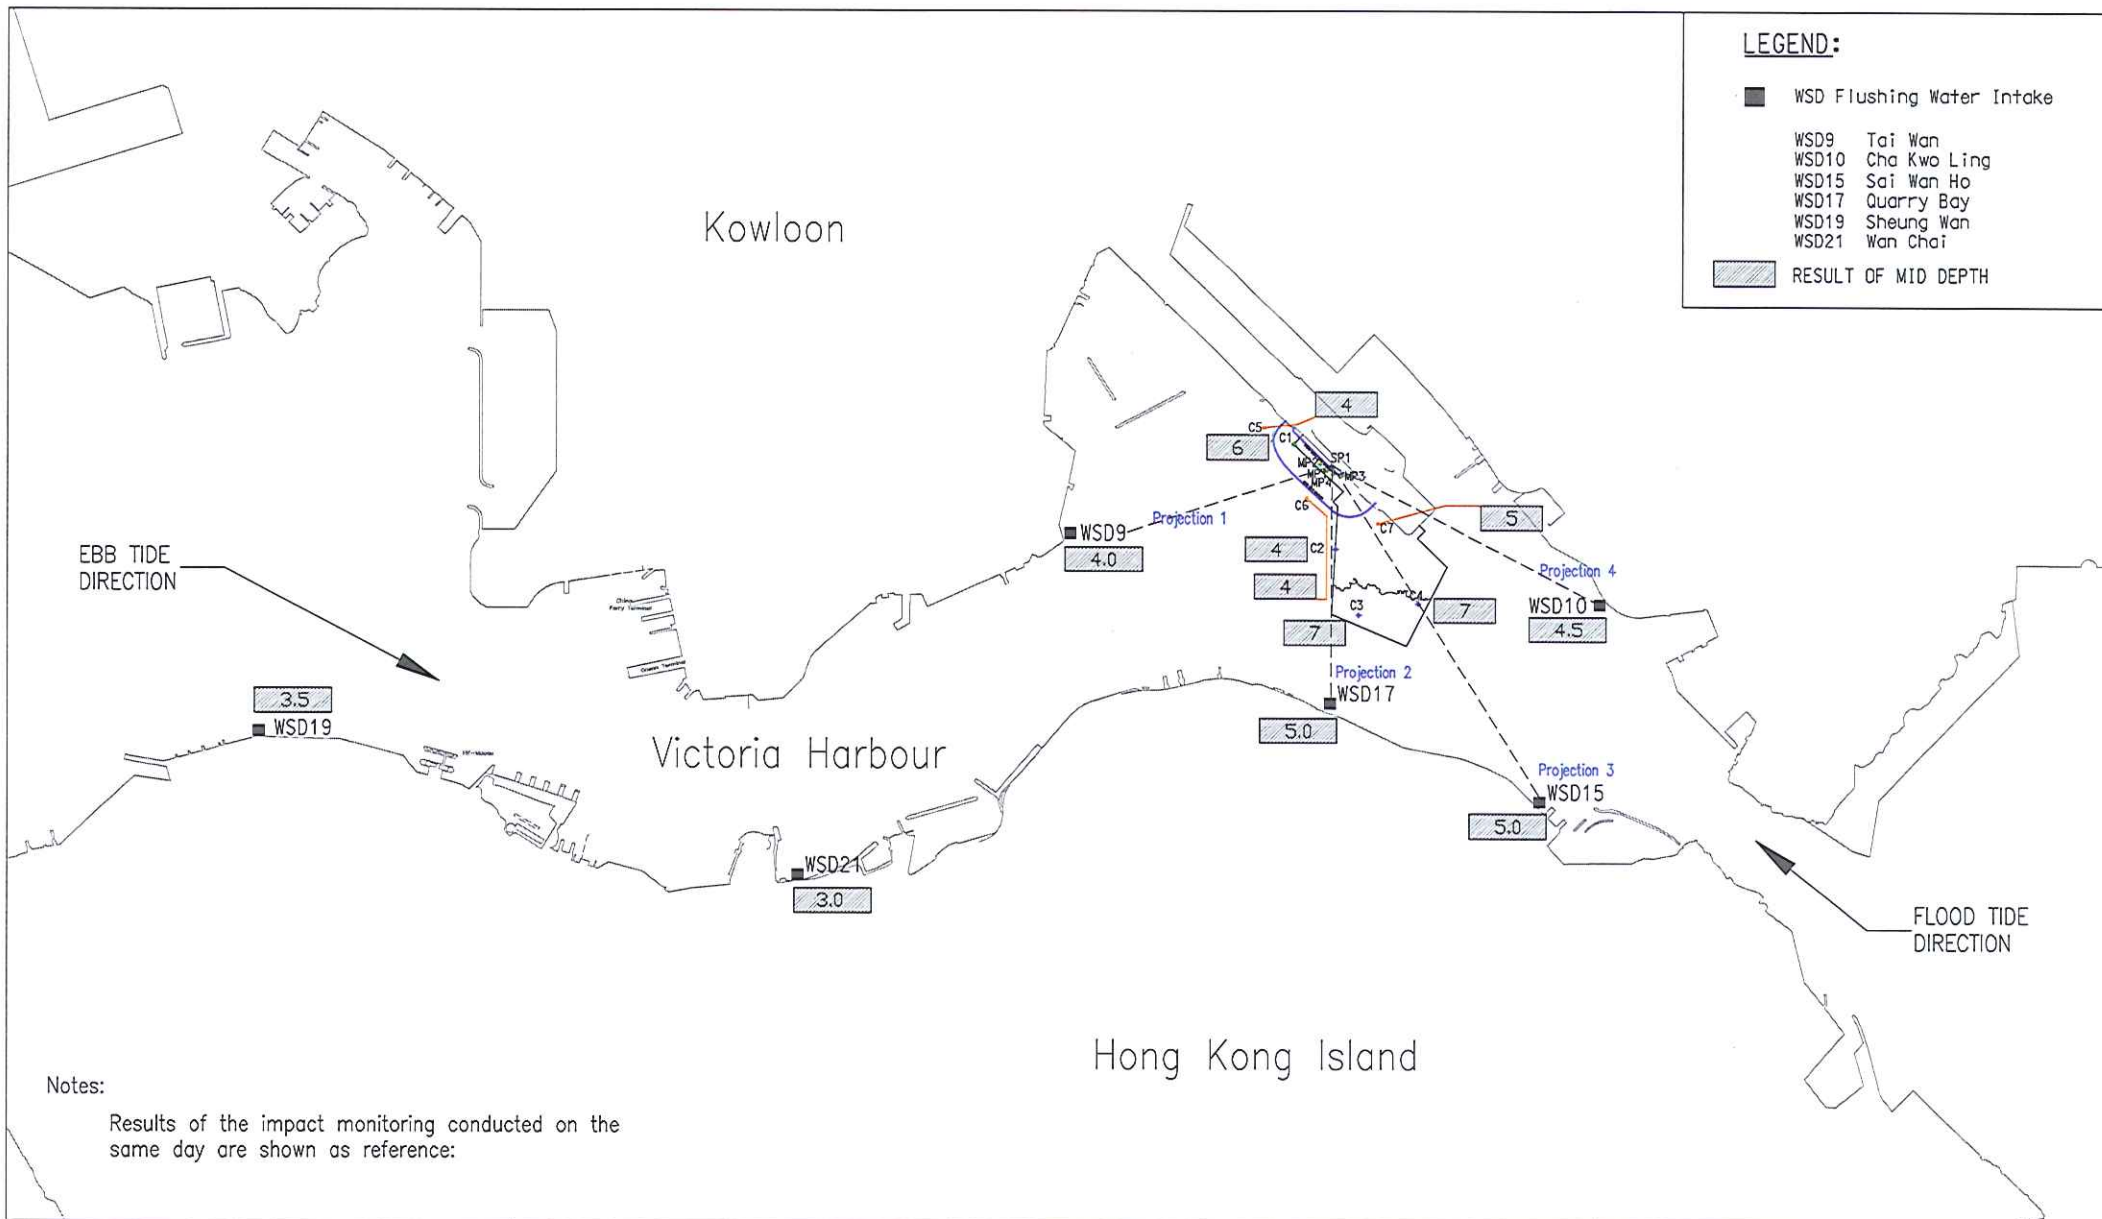

Notes:  
Results of the impact monitoring conducted on the same day are shown as reference:




PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
WATER QUALITY SURVEILLANCE SYSTEM - (3 Sep 2012 Ebb) - Page 2


DATE 17 Sep 2012	PREPARED BY HP
SCALE NOT TO SCALE	SKETCH No. SK-0881

**Legend**


- Tidal Direction
- Action Level for WSD intake
- Limit Level for WSD intake

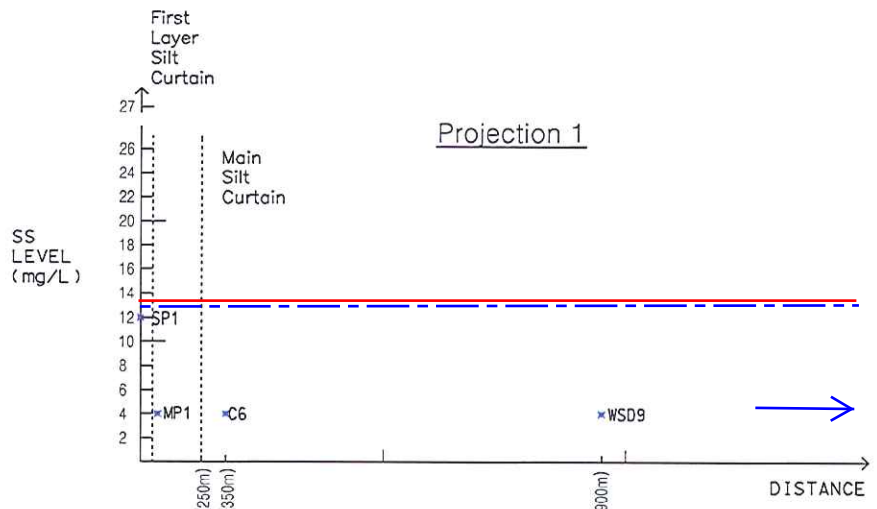


Description: WSD9 was located at upstream which was well within the Action Level.

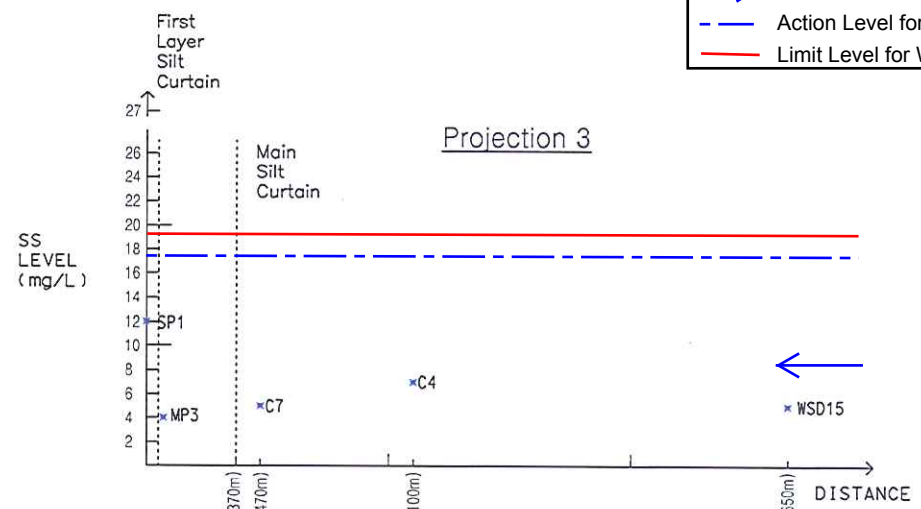

Description: WSD15 was located at downstream which was well within the Action Level.

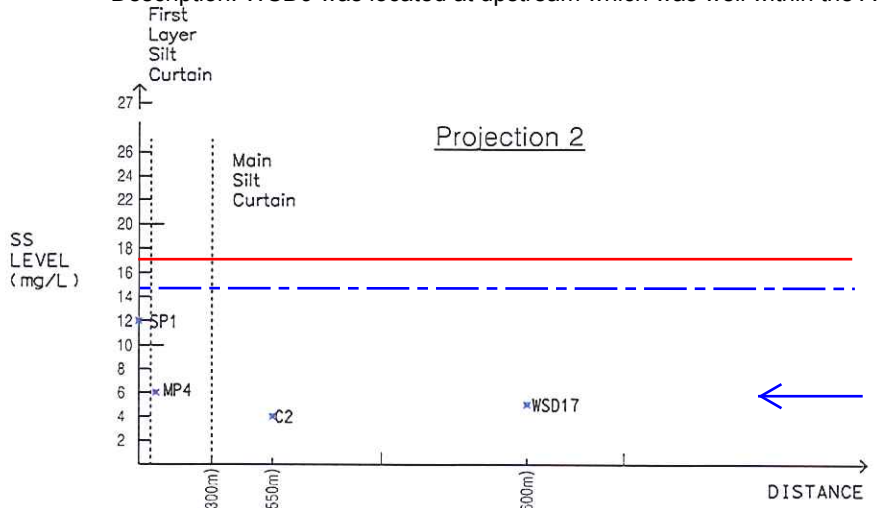

Description: WSD17 was located at downstream which was well within the Action Level.

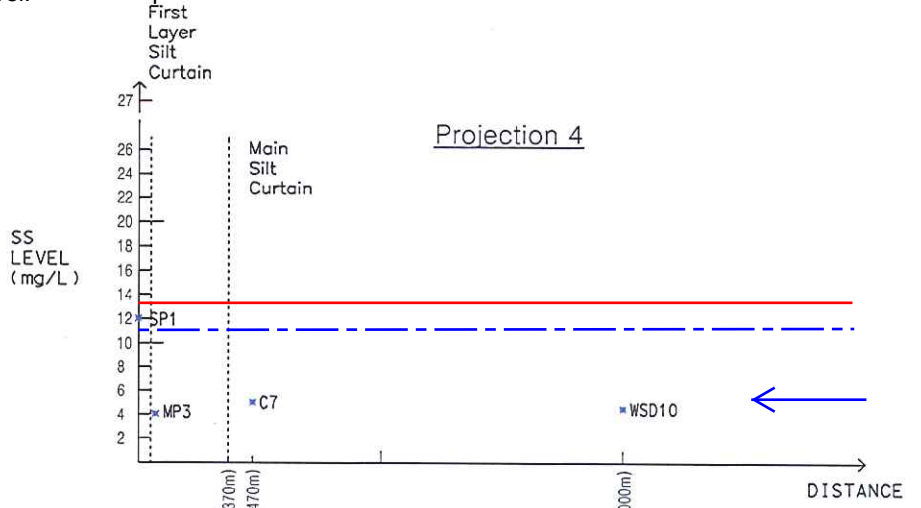

Description: WSD10 was located at downstream which was well within the Action Level.



PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**

TITLE  
 GRAPHICAL PRESENTATION OF THE WATER  
 QUALITY SURVEILLANCE SYSTEM MONITORING  
 RESULTS AT MID DEPTH - (3 Sep 2012 Ebb)

DATE 17 Sep 2012	PREPARED BY HP
SCALE NOT TO SCALE	SKETCH No. SK-0882




Water Quality Surveillance System Monitoring Results - 19 September 2012 (Flood Tide)

Monitoring Location		Turbidity in NTU	Compare to Trigger Level	Suspended Solids in mg/L	Compare to Trigger Level
SP1	1m below the surface	4.65	N/A	10	N/A
	mid depth	4.91	N/A	10	N/A
	1m above the seabed	4.63	N/A	7	N/A
MP1	1m below the surface	2.31	N/A	7	N/A
	mid depth	4.78	N/A	9	N/A
	1m above the seabed	3.49	N/A	9	N/A
MP2	1m below the surface	3.08	N/A	6	N/A
	mid depth	3.08	N/A	6	N/A
	1m above the seabed	3.47	N/A	6	N/A
MP3	1m below the surface	2.91	N/A	7	N/A
	mid depth	3.63	N/A	9	N/A
	1m above the seabed	3.49	N/A	7	N/A
MP4	1m below the surface	3.20	N/A	9	N/A
	mid depth	4.36	N/A	10	N/A
	1m above the seabed	4.21	N/A	9	N/A
C1	1m below the surface	2.78	<b>Lower</b>	7	<b>Lower</b>
	mid depth	2.68	<b>Lower</b>	6	<b>Lower</b>
	1m above the seabed	3.31	<b>Lower</b>	8	<b>Lower</b>
C2	1m below the surface	3.58	<b>Lower</b>	8	<b>Lower</b>
	mid depth	2.98	<b>Lower</b>	7	<b>Lower</b>
	1m above the seabed	3.92	<b>Lower</b>	6	<b>Lower</b>
C3	1m below the surface	2.17	<b>Lower</b>	6	<b>Lower</b>
	mid depth	2.38	<b>Lower</b>	6	<b>Lower</b>
	1m above the seabed	2.17	<b>Lower</b>	5	<b>Lower</b>
C4	1m below the surface	1.93	<b>Lower</b>	5	<b>Lower</b>
	mid depth	1.62	<b>Lower</b>	5	<b>Lower</b>
	1m above the seabed	1.88	<b>Lower</b>	5	<b>Lower</b>
C5	1m below the surface	3.67	N/A	4	N/A
	mid depth	3.84	N/A	8	N/A
	1m above the seabed	2.87	N/A	8	N/A
C6	1m below the surface	3.88	N/A	8	N/A
	mid depth	4.71	N/A	10	N/A
	1m above the seabed	2.62	N/A	7	N/A
C7	1m below the surface	2.76	N/A	6	N/A
	mid depth	2.90	N/A	7	N/A
	1m above the seabed	3.31	N/A	8	N/A

Control Point	Trigger Level for Turbidity in NTU for All Season	Trigger Level for SS in mg/L for Wet Season (April - September)
C1	12.3 for Flood Tide	18.5
C2	12.3 for Flood Tide	
C3	16.9	
C4	10.5 for Ebb Tide	



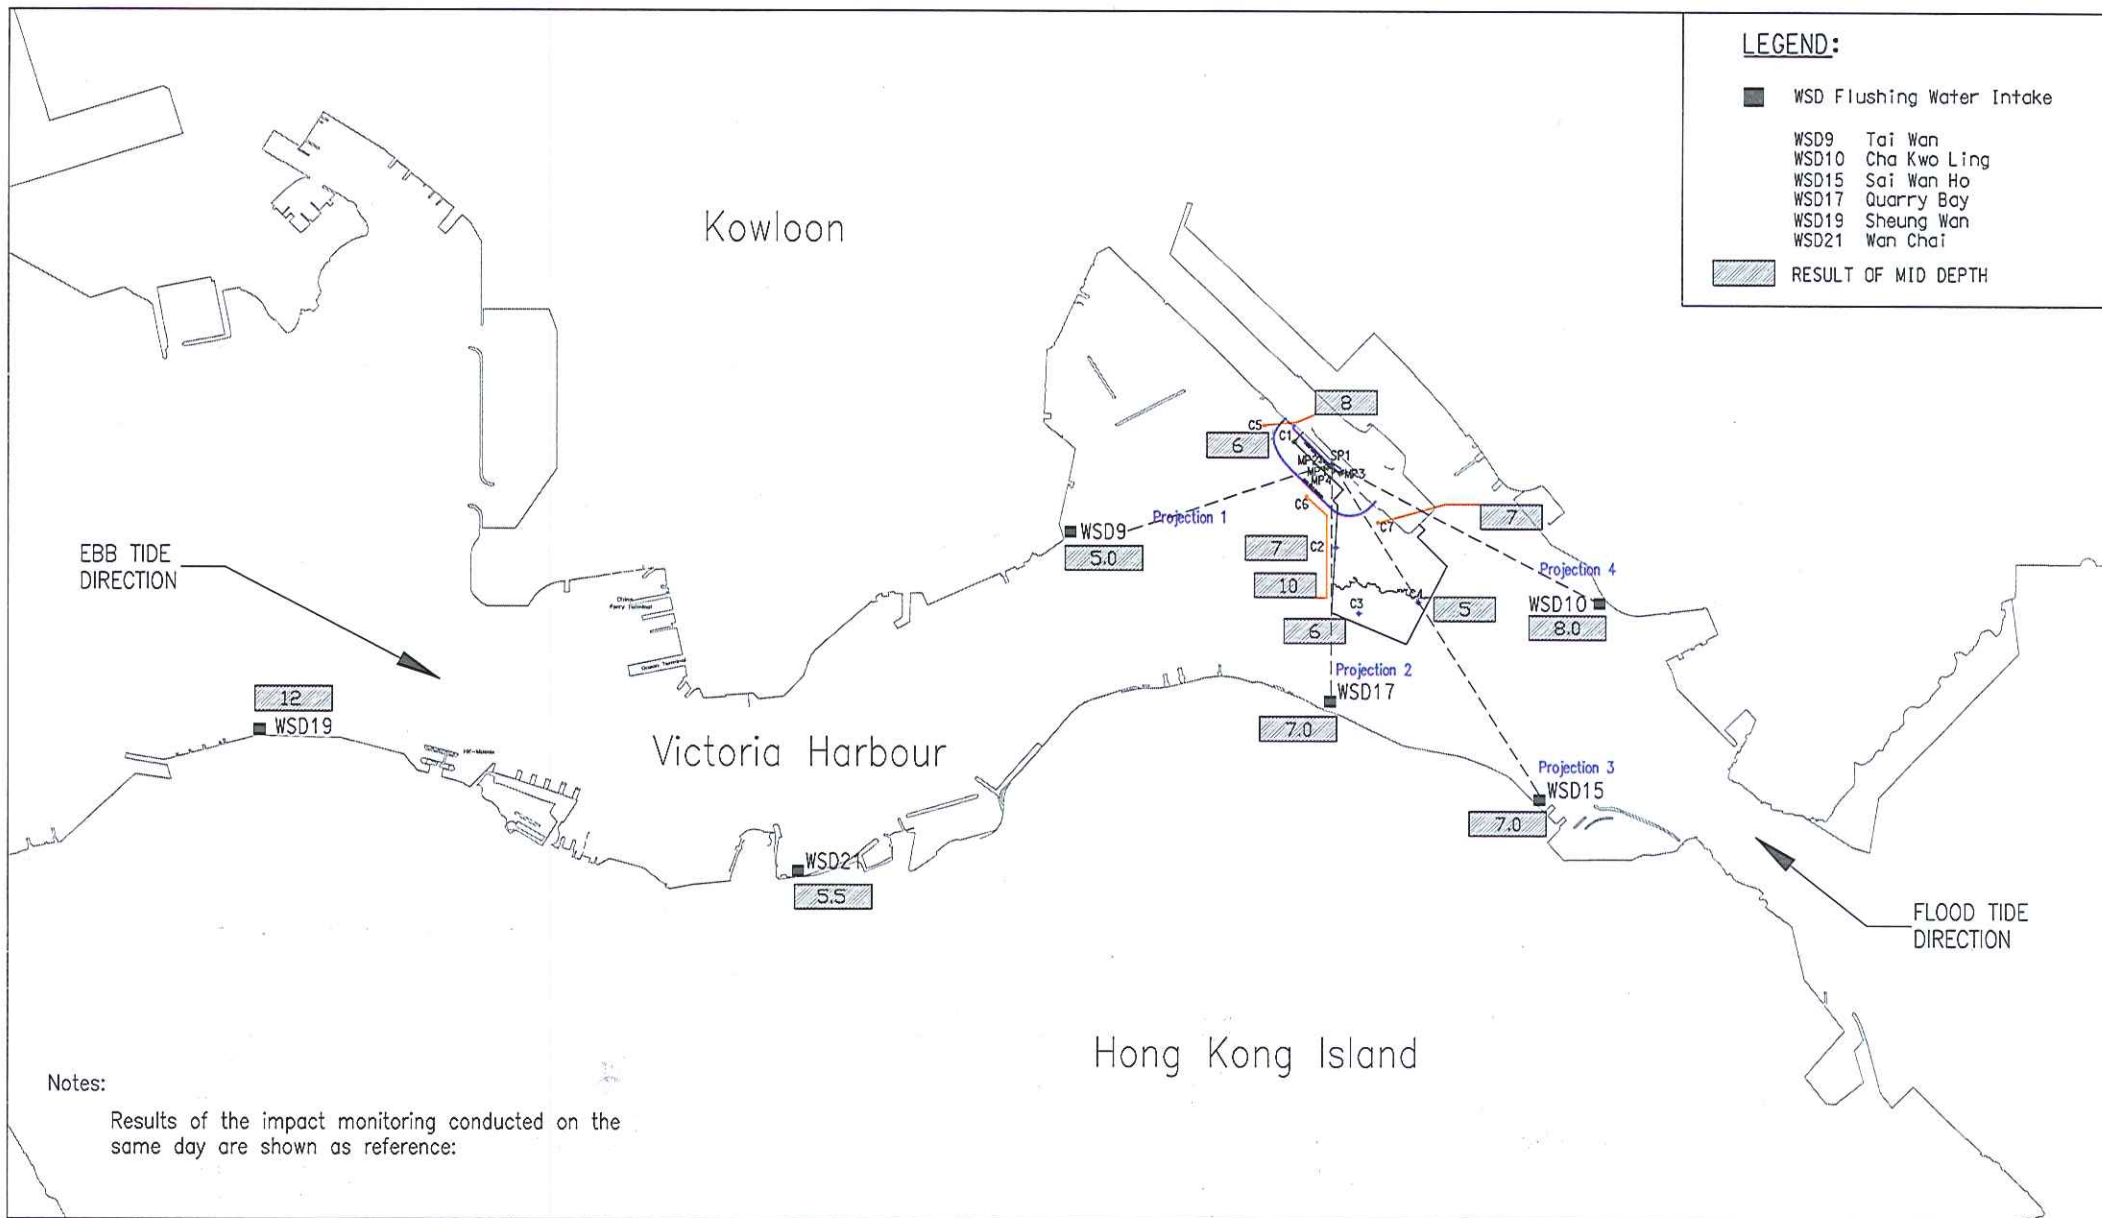

**LEGEND:**

- WSD Flushing Water Intake
- WSD9 Tai Wan
- WSD10 Cha Kwo Ling
- WSD15 Sai Wan Ho
- WSD17 Quarry Bay
- WSD19 Sheung Wan
- WSD21 Wan Chai
- ▨ RESULT OF MID DEPTH

**Notes:**

Results of the impact monitoring conducted on the same day are shown as reference:



PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**


TITLE  
 WATER QUALITY SURVEILLANCE SYSTEM – (19 Sep 2012 FLOOD) – Page 2

DATE 9 Oct 2012	PREPARED BY HP
SCALE NOT TO SCALE	SKETCH No. SK-0913




**Legend**


- Tidal Direction
- Action Level for WSD intake
- Limit Level for WSD intake

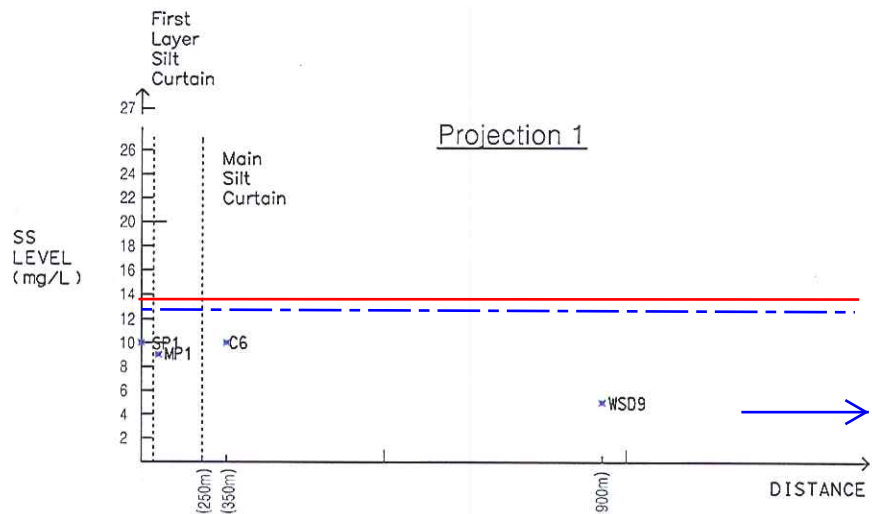


Description: WSD9 was located at downstream which was well within the Action Level.

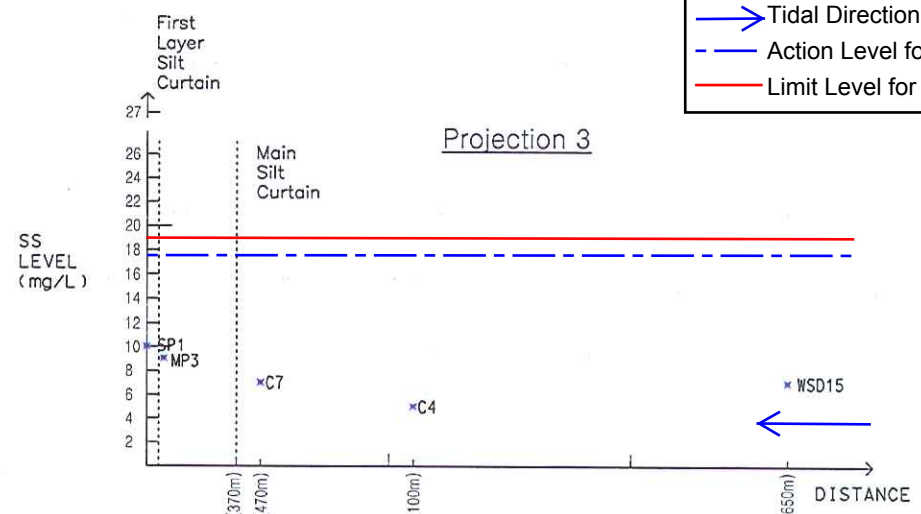

Description: WSD15 was located at upstream which was well within the Action Level.

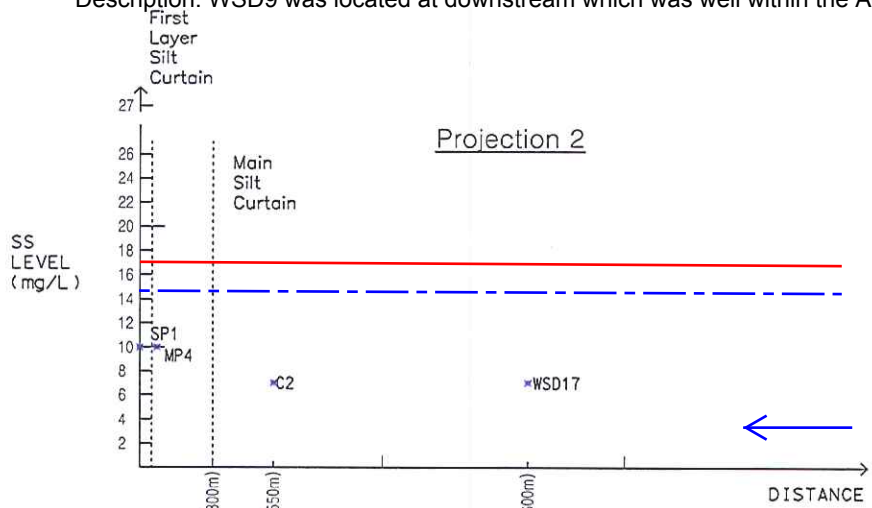

Description: WSD17 was located at upstream which was well within the Action Level.

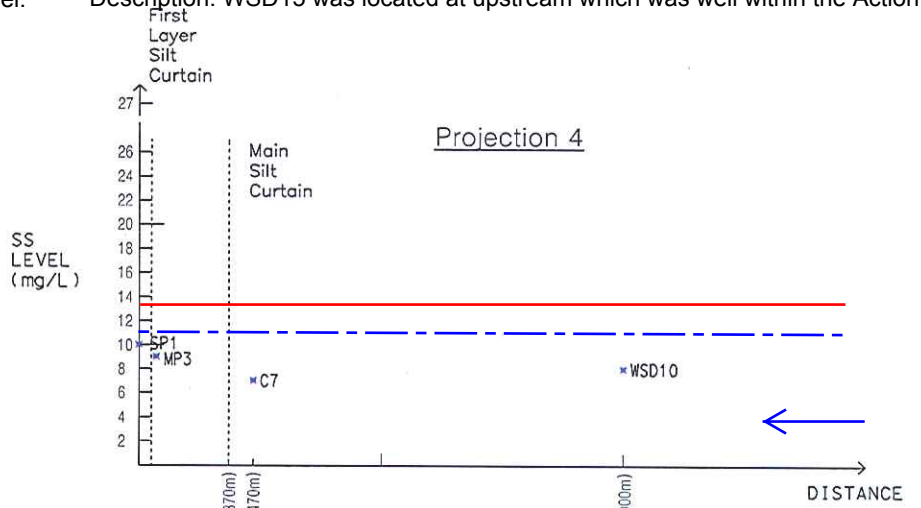

Description: WSD10 was located at upstream which was well within the Action Level.




PROJECT KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development		DATE 9 Oct 2012	PREPARED BY HP
TITLE GRAPHICAL PRESENTATION OF THE WATER QUALITY SURVEILLANCE SYSTEM MONITORING RESULTS AT MID DEPTH - (19 Sep 2012 FLOOD)		SCALE NOT TO SCALE	SKETCH No. SK-0914



Water Quality Surveillance System Monitoring Results - 10 October 2012 (Ebb Tide)

Monitoring Location		Turbidity in NTU	Compare to Trigger Level	Suspended Solids in mg/L	Compare to Trigger Level
SP1	1m below the surface	28.2	N/A	43	N/A
	mid depth	10.9	N/A	20	N/A
	1m above the seabed	10.8	N/A	32	N/A
MP1	1m below the surface	3.07	N/A	8	N/A
	mid depth	2.87	N/A	11	N/A
	1m above the seabed	2.84	N/A	6	N/A
MP2	1m below the surface	2.42	N/A	5	N/A
	mid depth	2.14	N/A	5	N/A
	1m above the seabed	2.40	N/A	3	N/A
MP3	1m below the surface	3.15	N/A	5	N/A
	mid depth	2.25	N/A	5	N/A
	1m above the seabed	2.28	N/A	7	N/A
MP4	1m below the surface	2.45	N/A	12	N/A
	mid depth	2.18	N/A	6	N/A
	1m above the seabed	1.95	N/A	7	N/A
C1	1m below the surface	2.10	<b>Lower</b>	6	<b>Lower</b>
	mid depth	1.90	<b>Lower</b>	6	<b>Lower</b>
	1m above the seabed	2.23	<b>Lower</b>	5	<b>Lower</b>
C2	1m below the surface	2.05	<b>Lower</b>	7	<b>Lower</b>
	mid depth	1.72	<b>Lower</b>	16	<b>Higher</b>
	1m above the seabed	1.79	<b>Lower</b>	6	<b>Lower</b>
C3	1m below the surface	2.71	<b>Lower</b>	3	<b>Lower</b>
	mid depth	2.41	<b>Lower</b>	2	<b>Lower</b>
	1m above the seabed	2.32	<b>Lower</b>	5	<b>Lower</b>
C4	1m below the surface	2.58	<b>Lower</b>	10	<b>Lower</b>
	mid depth	2.03	<b>Lower</b>	11	<b>Lower</b>
	1m above the seabed	2.05	<b>Lower</b>	3	<b>Lower</b>
C5	1m below the surface	2.73	N/A	8	N/A
	mid depth	2.08	N/A	4	N/A
	1m above the seabed	2.01	N/A	5	N/A
C6	1m below the surface	2.00	N/A	6	N/A
	mid depth	2.02	N/A	10	N/A
	1m above the seabed	2.27	N/A	5	N/A
C7	1m below the surface	2.06	N/A	4	N/A
	mid depth	2.24	N/A	6	N/A
	1m above the seabed	2.32	N/A	4	N/A

Control Point	Trigger Level for Turbidity in NTU for All Season	Trigger Level for SS in mg/L for Dry Season (October - March)
C1	12.3 for Flood Tide	14.0
C2	12.3 for Flood Tide	
C3	16.9	
C4	10.5 for Ebb Tide	

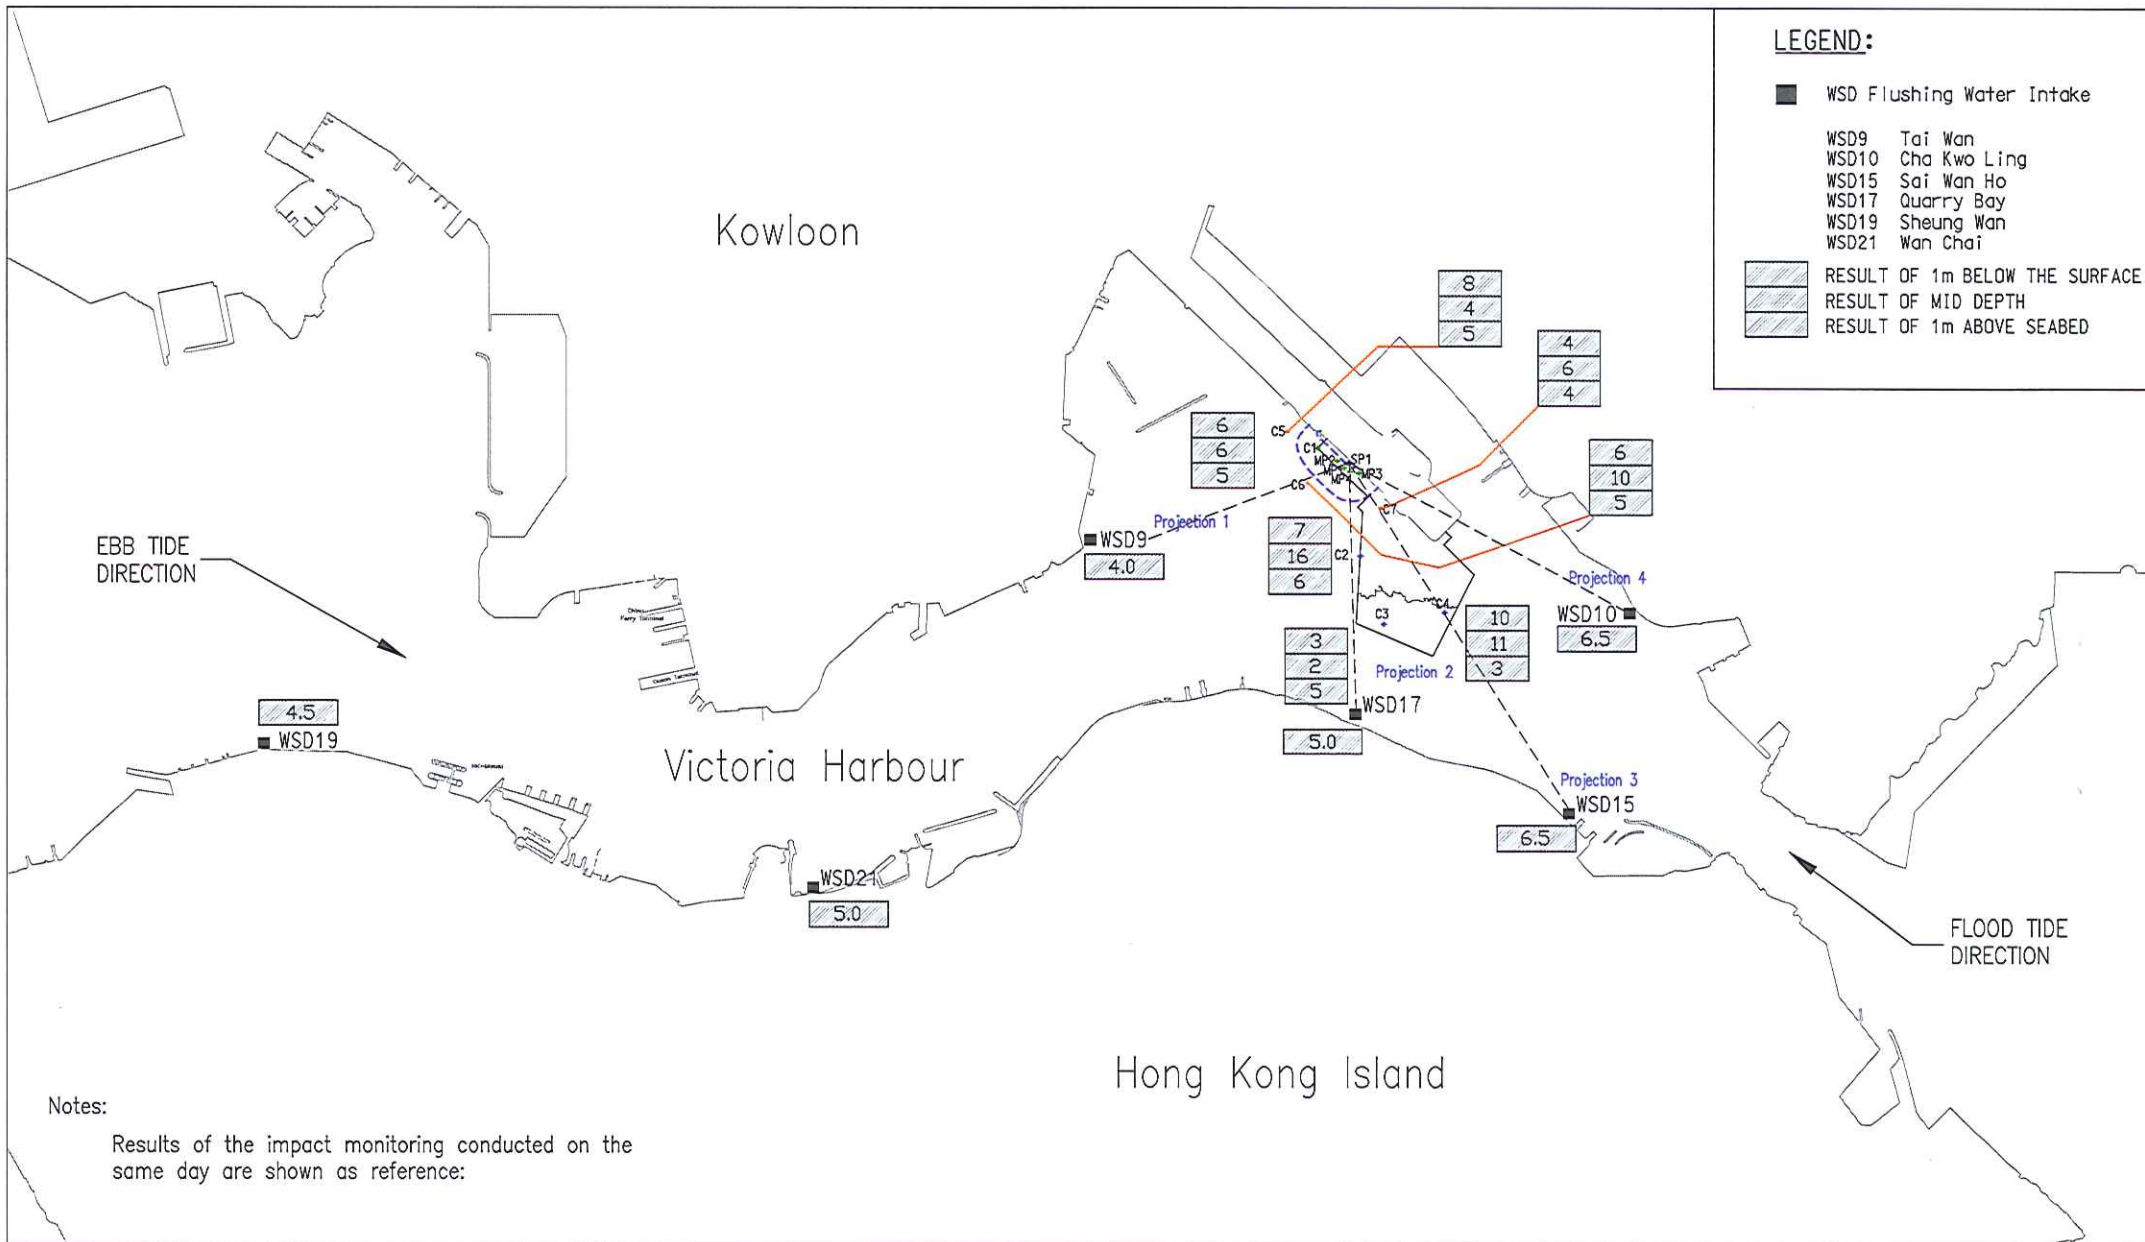

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development


TITLE  
WATER QUALITY SURVEILLANCE SYSTEM - (10 Oct 2012 EBB) - Page 1

DATE  
24 Oct 2012

PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0937

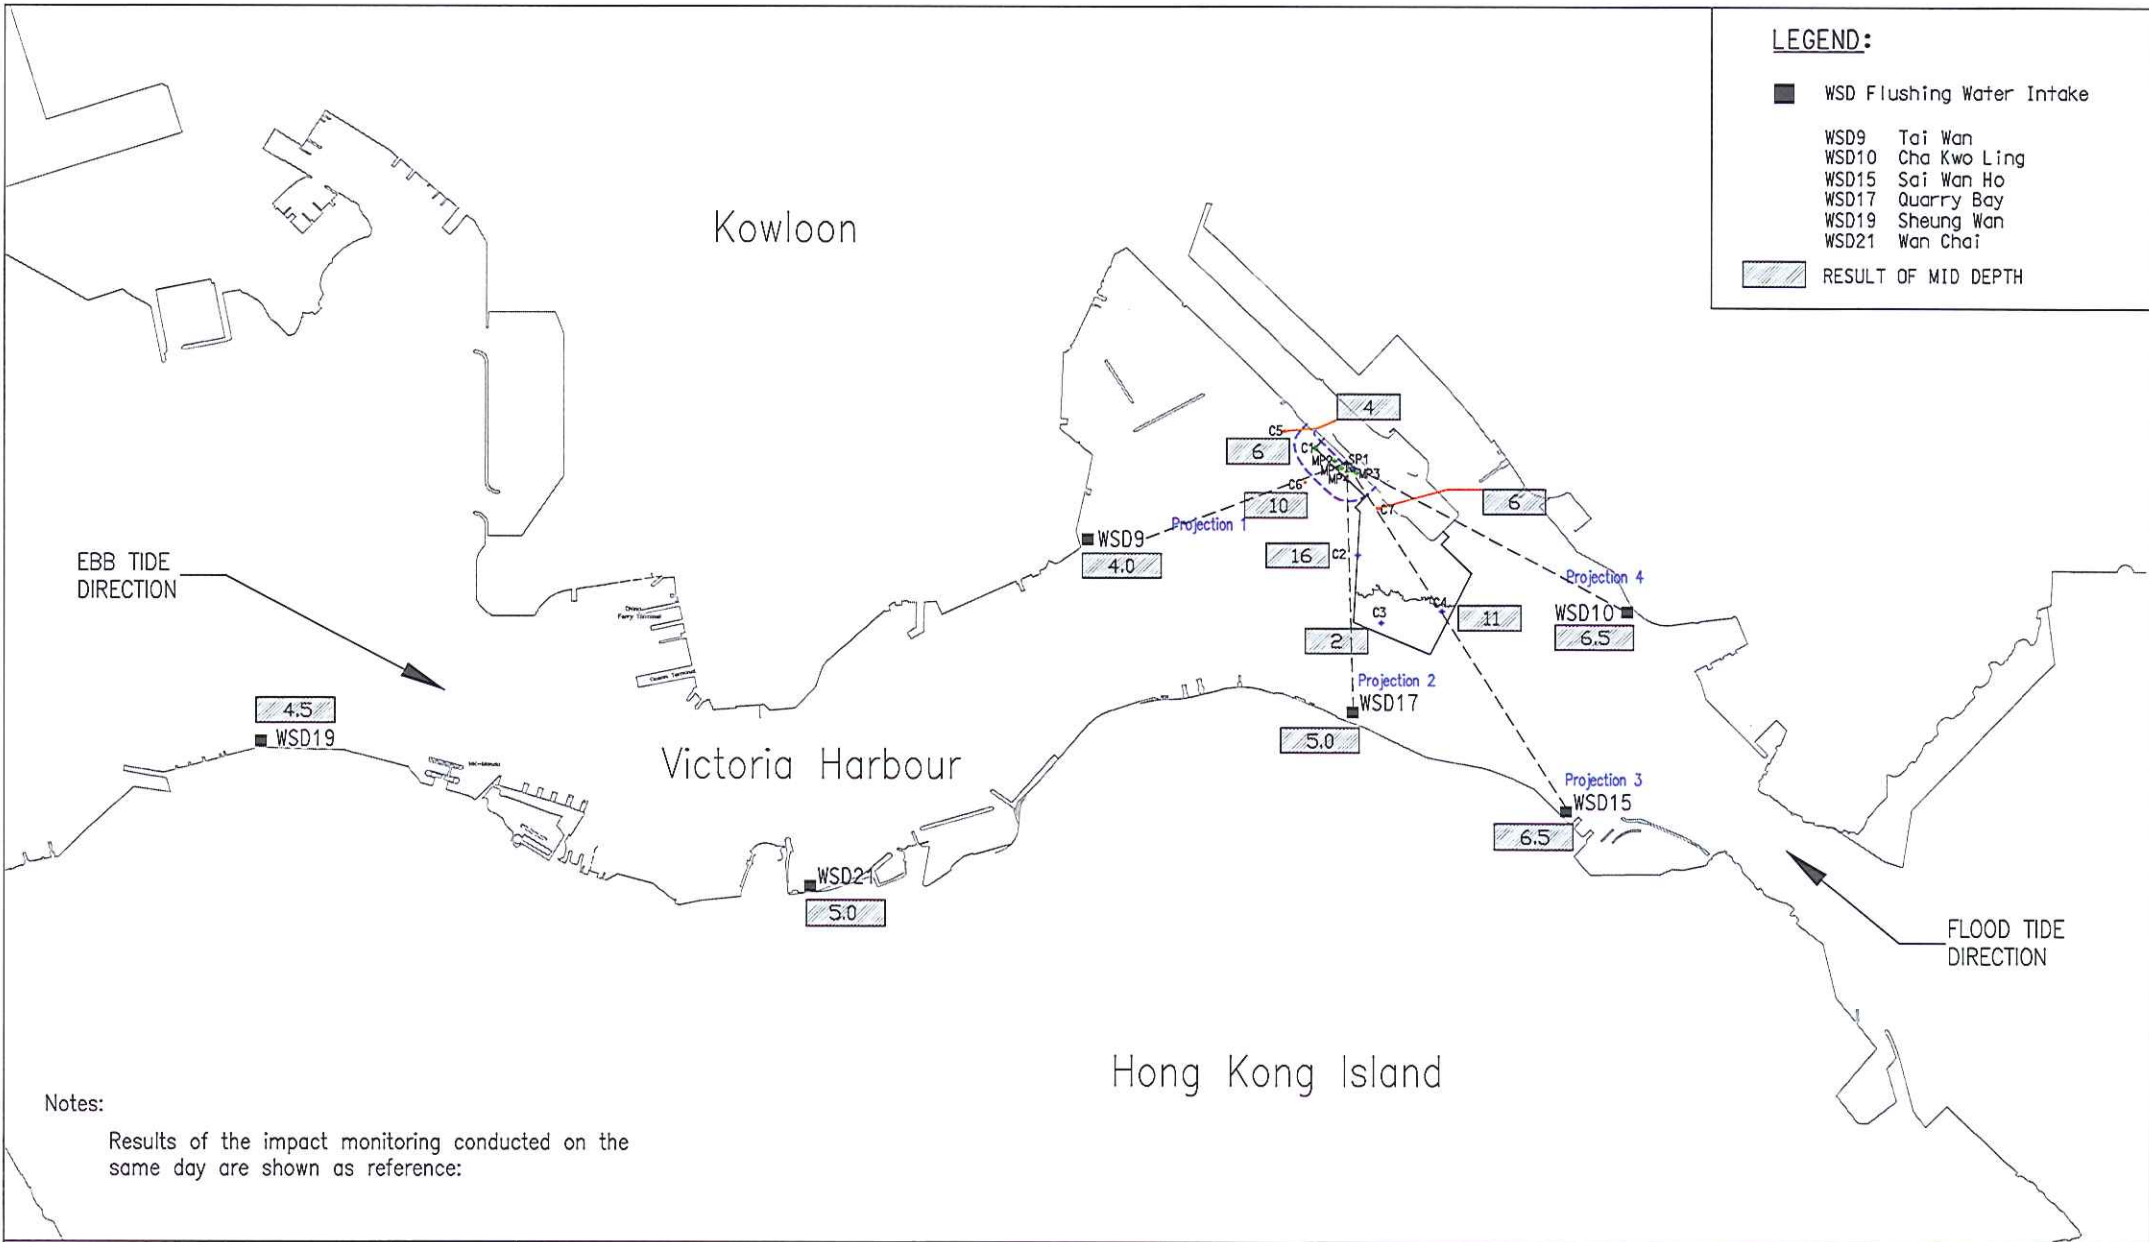

**LEGEND:**

- WSD Flushing Water Intake
- WSD9 Tai Wan
- WSD10 Cha Kwo Ling
- WSD15 Sai Wan Ho
- WSD17 Quarry Bay
- WSD19 Sheung Wan
- WSD21 Wan Chai
- ▨ RESULT OF MID DEPTH

Notes:  
Results of the impact monitoring conducted on the same day are shown as reference:




PROJECT KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development		DATE 24 Oct 2012	PREPARED BY PY
TITLE WATER QUALITY SURVEILLANCE SYSTEM - (10 Oct 2012 EBB) - Page 2		SCALE NOT TO SCALE	SKETCH No. SK-0938




**Legend**


- Tidal Direction
- Action Level for WSD intake
- Limit Level for WSD intake

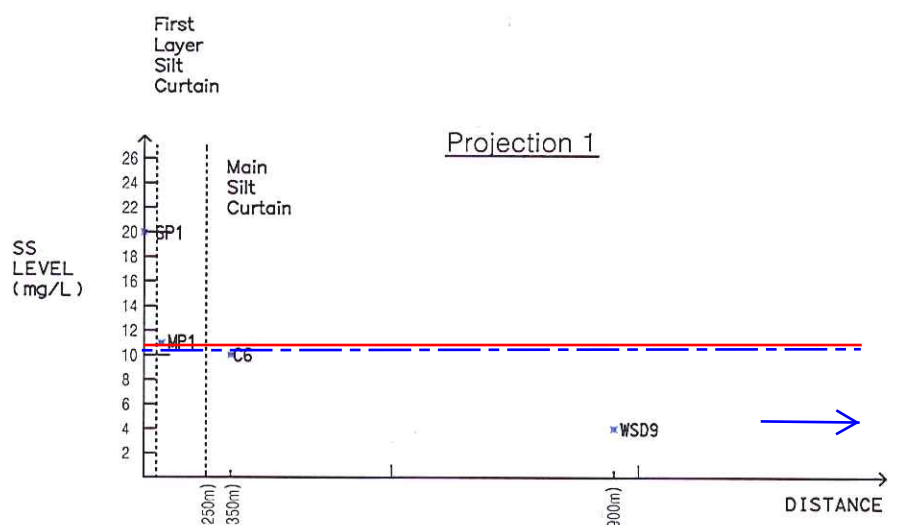


Description: WSD9 was located at upstream which was well within the Action Level.

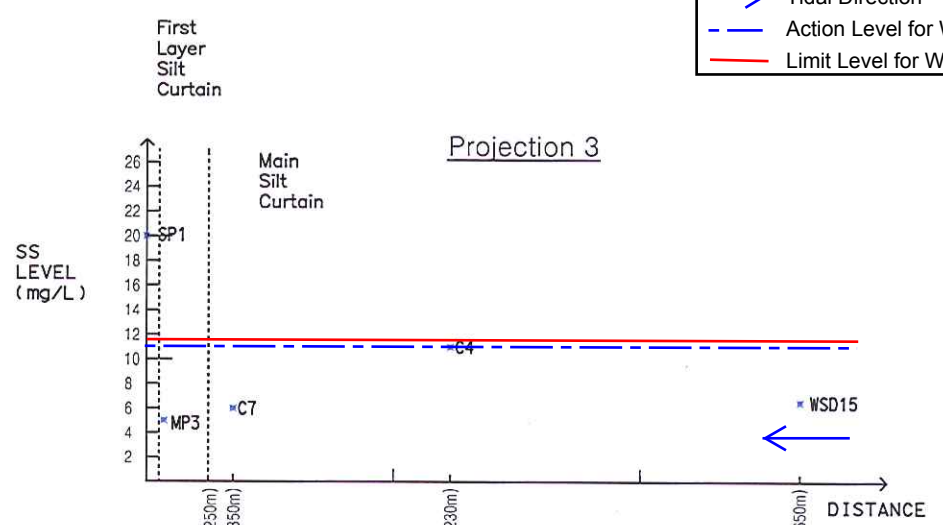

Description: WSD15 was located at downstream which was well within the Action Level.

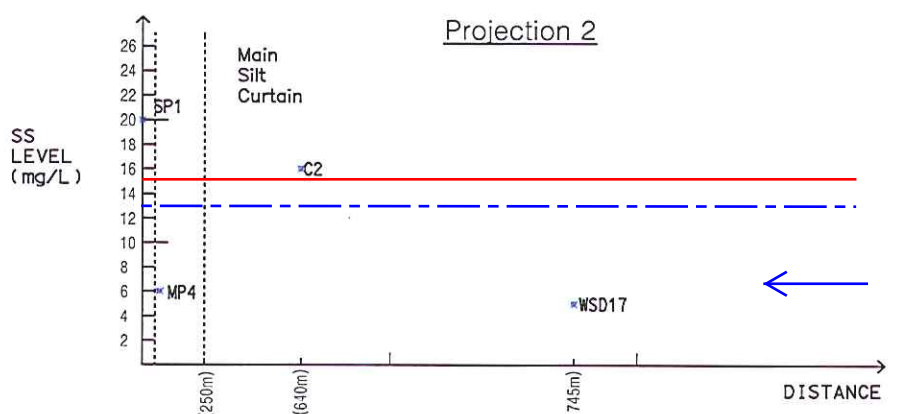

Description: WSD17 was located at downstream which was well within the Action Level.

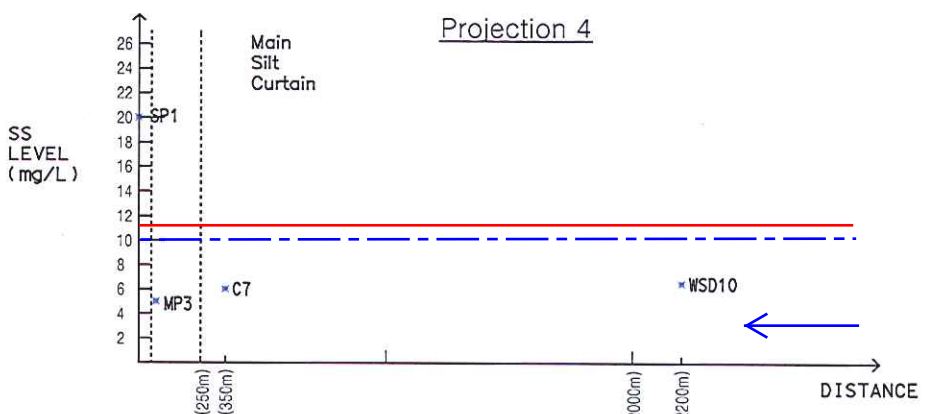

Description: WSD10 was located at downstream which was well within the Action Level.



PROJECT KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development	DATE 24 Oct 2012	PREPARED BY PY
	SCALE NOT TO SCALE	SKETCH No. SK-0939
TITLE GRAPHICAL PRESENTATION OF THE WATER QUALITY SURVEILLANCE SYSTEM MONITORING RESULTS AT MID DEPTH - (10 Oct 2012 EBB)		

Photograph taken right before sampling at monitoring station C2 shown vessels and marine traffic upstream




Water Quality Surveillance System Monitoring Results - 25 October 2012 (Flood Tide)

Monitoring Location		Turbidity in NTU	Compare to Trigger Level	Suspended Solids in mg/L	Compare to Trigger Level
SP1	1m below the surface	10.7	N/A	19	N/A
	mid depth	12.6	N/A	20	N/A
	1m above the seabed	13.6	N/A	8	N/A
MP1	1m below the surface	7.24	N/A	8	N/A
	mid depth	4.56	N/A	10	N/A
	1m above the seabed	5.48	N/A	10	N/A
MP2	1m below the surface	5.95	N/A	11	N/A
	mid depth	4.30	N/A	9	N/A
	1m above the seabed	4.47	N/A	10	N/A
MP3	1m below the surface	4.46	N/A	9	N/A
	mid depth	5.21	N/A	8	N/A
	1m above the seabed	4.69	N/A	10	N/A
MP4	1m below the surface	3.22	N/A	12	N/A
	mid depth	6.38	N/A	13	N/A
	1m above the seabed	7.45	N/A	10	N/A
C1	1m below the surface	3.53	<b>Lower</b>	10	<b>Lower</b>
	mid depth	3.81	<b>Lower</b>	10	<b>Lower</b>
	1m above the seabed	4.46	<b>Lower</b>	8	<b>Lower</b>
C2	1m below the surface	4.84	<b>Lower</b>	14	<b>Equal</b>
	mid depth	4.21	<b>Lower</b>	14	<b>Equal</b>
	1m above the seabed	3.91	<b>Lower</b>	10	<b>Lower</b>
C3	1m below the surface	5.14	<b>Lower</b>	9	<b>Lower</b>
	mid depth	3.53	<b>Lower</b>	10	<b>Lower</b>
	1m above the seabed	3.25	<b>Lower</b>	9	<b>Lower</b>
C4	1m below the surface	5.13	<b>Lower</b>	9	<b>Lower</b>
	mid depth	5.12	<b>Lower</b>	10	<b>Lower</b>
	1m above the seabed	4.93	<b>Lower</b>	12	<b>Lower</b>
C5	1m below the surface	5.59	N/A	13	N/A
	mid depth	6.39	N/A	11	N/A
	1m above the seabed	6.71	N/A	9	N/A
C6	1m below the surface	3.43	N/A	8	N/A
	mid depth	4.27	N/A	8	N/A
	1m above the seabed	3.54	N/A	7	N/A
C7	1m below the surface	5.29	N/A	9	N/A
	mid depth	4.71	N/A	9	N/A
	1m above the seabed	4.66	N/A	8	N/A

Control Point	Trigger Level for Turbidity in NTU for All Season	Trigger Level for SS in mg/L for Dry Season (October - March)
C1	12.3 for Flood Tide	14.0
C2	12.3 for Flood Tide	
C3	16.9	
C4	10.5 for Ebb Tide	





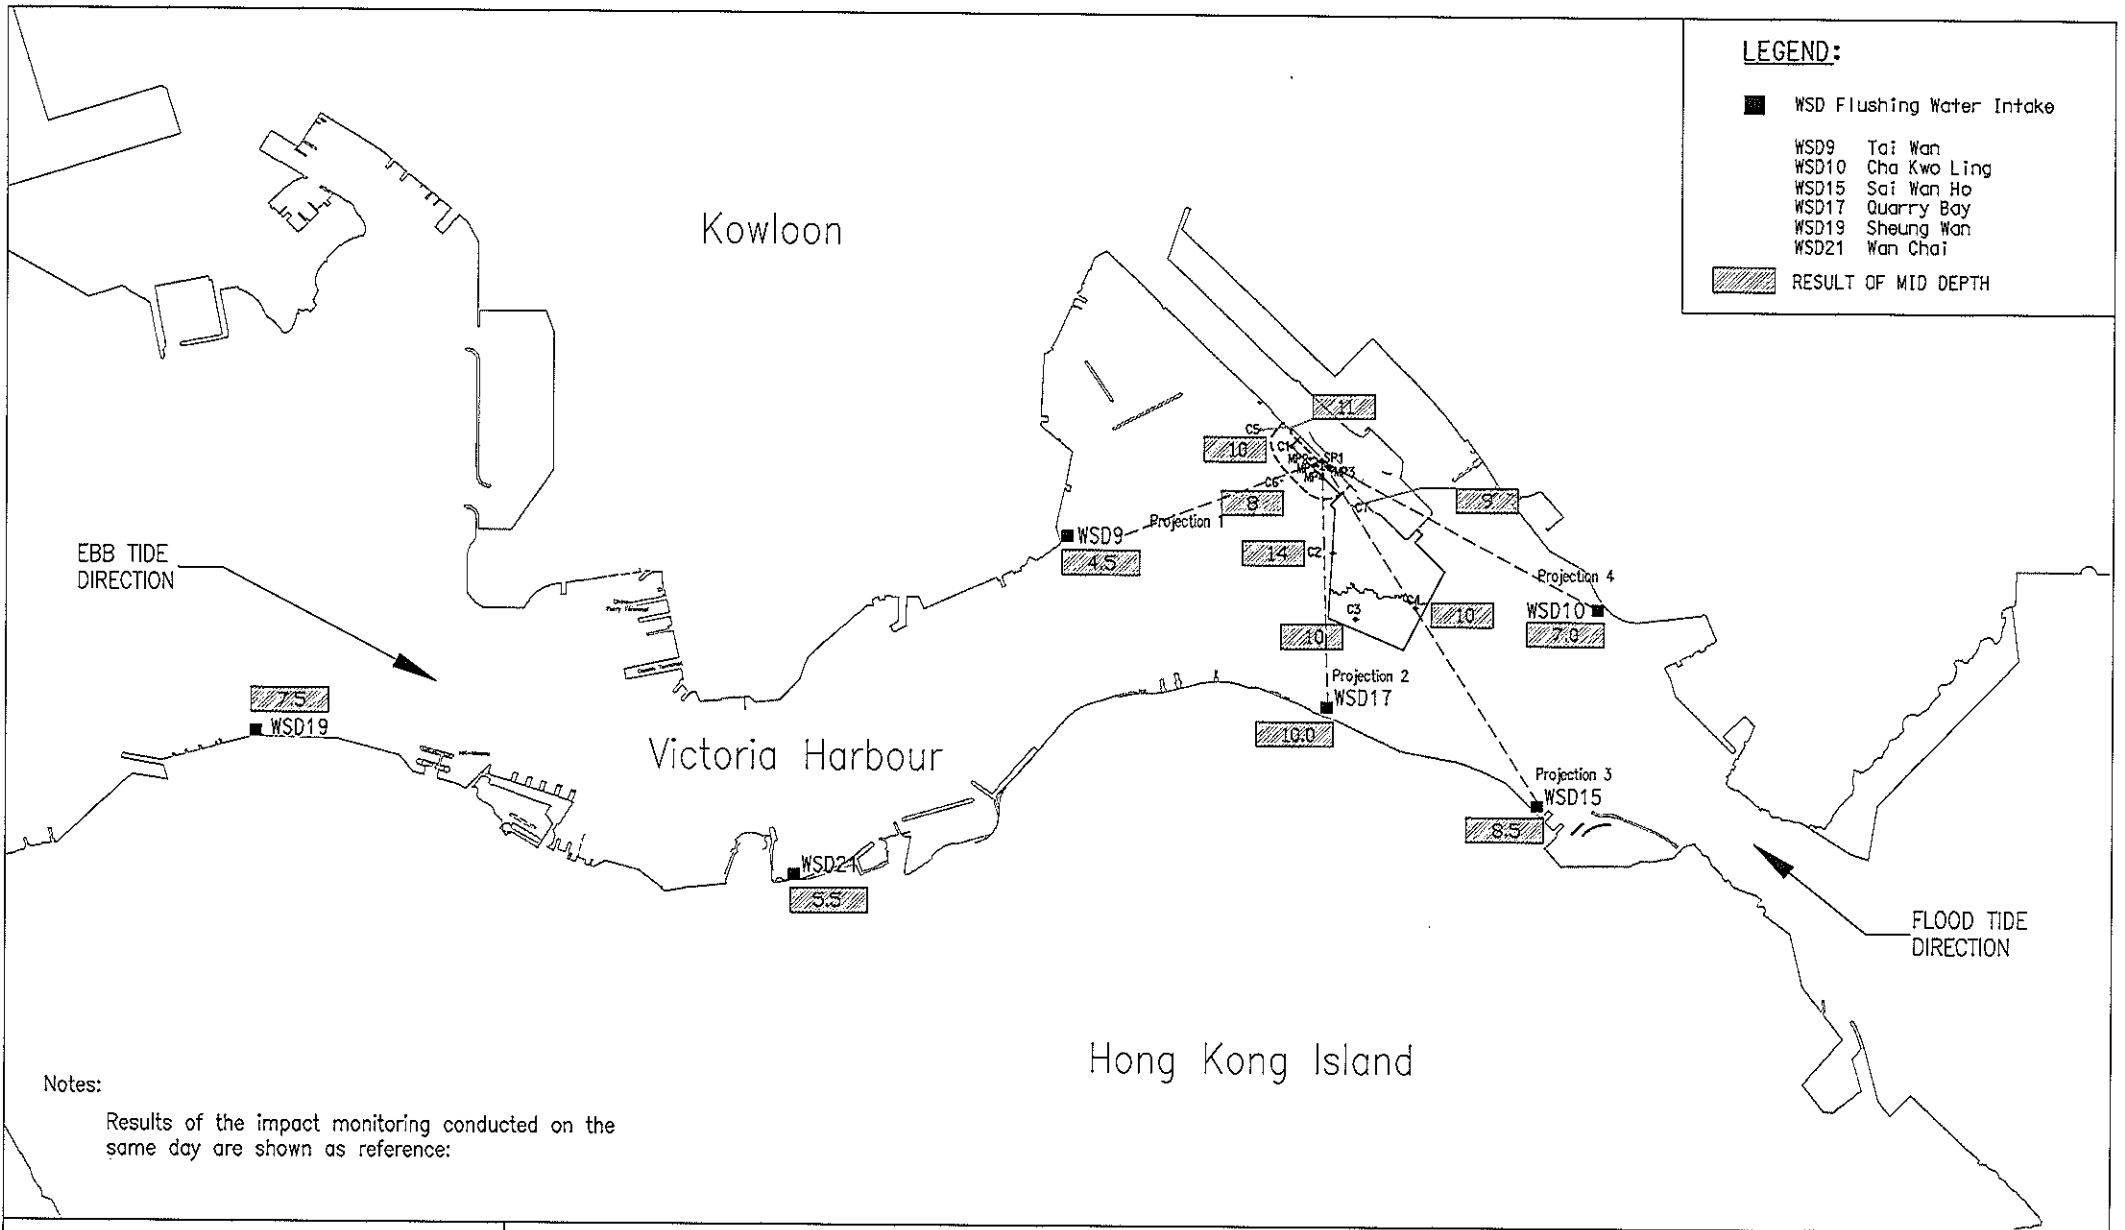

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
WATER QUALITY SURVEILLANCE SYSTEM - (25 Oct 2012 FLOOD) - Page 2

DATE  
7 Nov 2012


PREPARED BY  
PH

SCALE  
NOT TO SCALE


SKETCH No.  
SK-0944

**Legend**


- Tidal Direction
- Action Level for WSD intake
- Limit Level for WSD intake

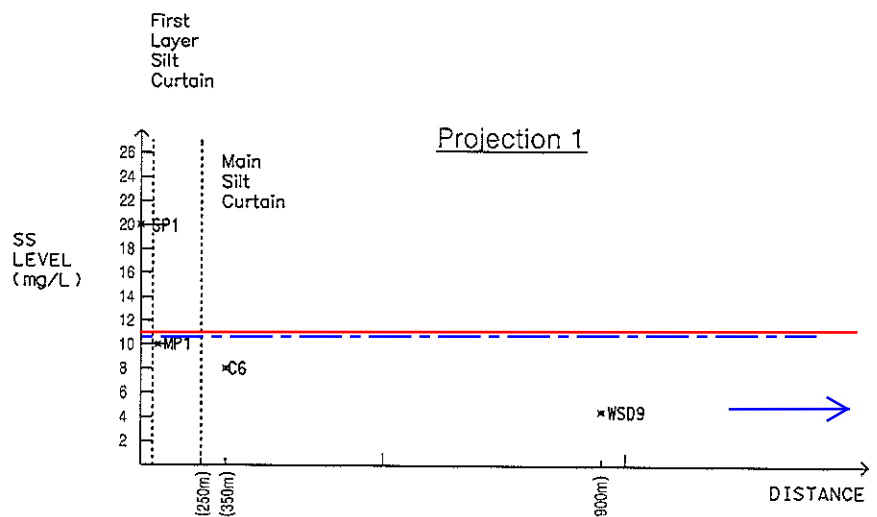


Description: WSD9 was located at upstream which was well within the Action Level.

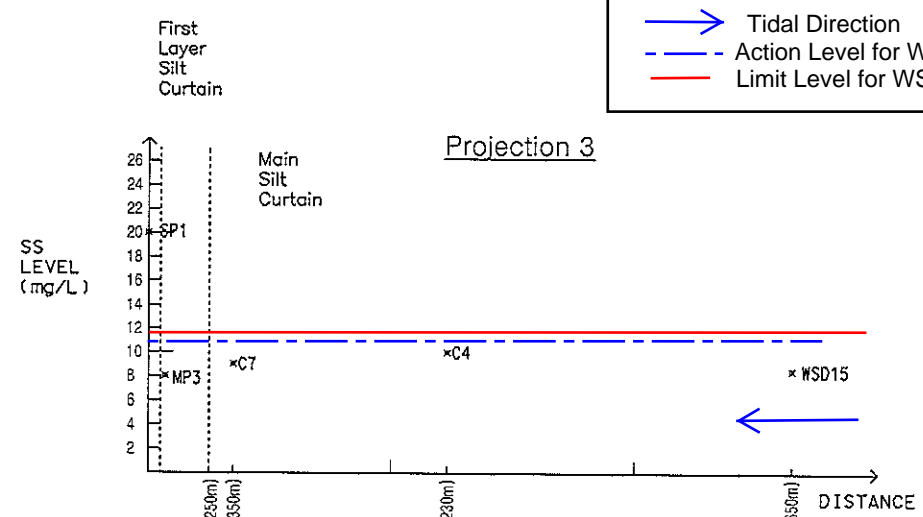

Description: WSD15 was located at upstream which was well within the Action Level.

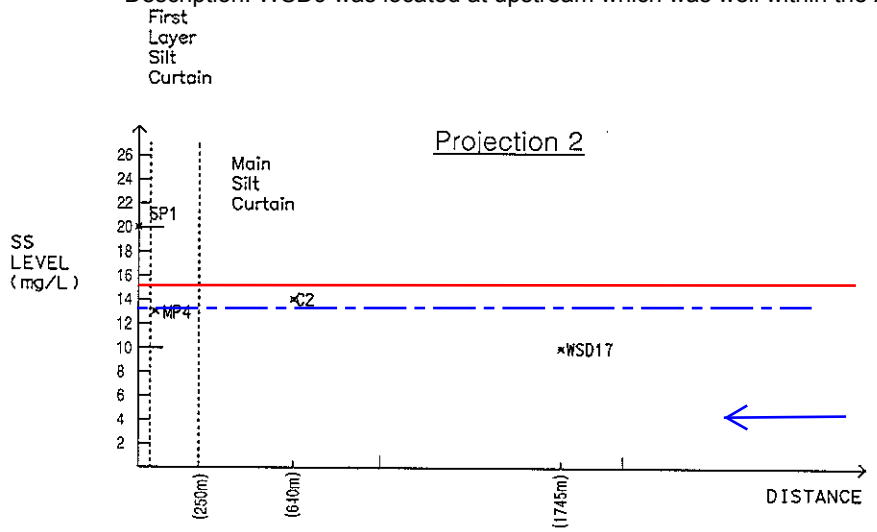

Description: WSD17 was located at upstream which was well within the Action Level.

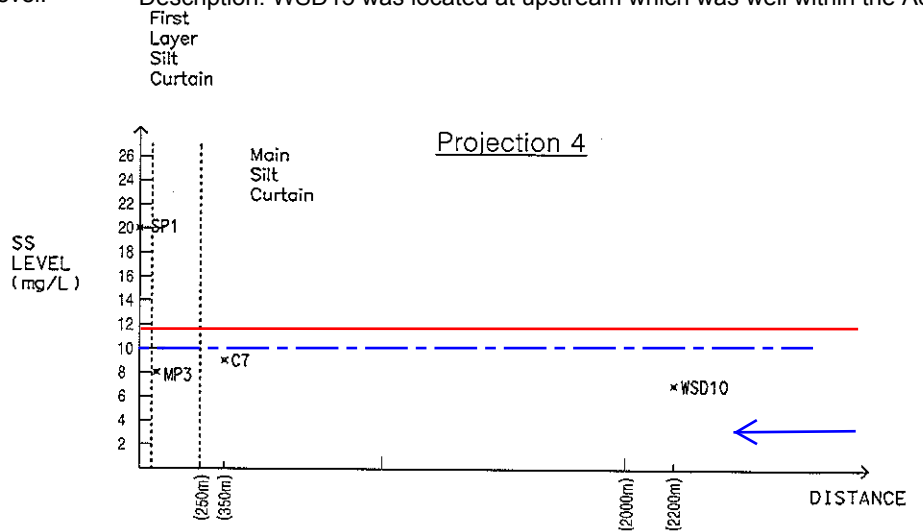

Description: WSD10 was located at upstream which was well within the Action Level.



PROJECT  
**KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development**

TITLE  
 GRAPHICAL PRESENTATION OF THE WATER  
 QUALITY SURVEILLANCE SYSTEM MONITORING  
 RESULTS AT MID DEPTH - (25 Oct 2012 FLOOD)

DATE  
 7 Nov 2012

PREPARED BY  
 PH


SCALE  
 NOT TO SCALE

SKETCH No.  
 SK-0945

Water Quality Surveillance System Monitoring Results - 12 November 2012 (Ebb Tide)

Monitoring Location		Turbidity in NTU	Compare to Trigger Level	Suspended Solids in mg/L	Compare to Trigger Level
SP1	1m below the surface	4.81	N/A	5	N/A
	mid depth	4.20	N/A	5	N/A
	1m above the seabed	17.1	N/A	12	N/A
MP1	1m below the surface	7.00	N/A	11	N/A
	mid depth	5.80	N/A	7	N/A
	1m above the seabed	6.15	N/A	8	N/A
MP2	1m below the surface	3.71	N/A	5	N/A
	mid depth	3.80	N/A	6	N/A
	1m above the seabed	3.65	N/A	4	N/A
MP3	1m below the surface	3.59	N/A	4	N/A
	mid depth	3.72	N/A	4	N/A
	1m above the seabed	3.96	N/A	4	N/A
MP4	1m below the surface	5.43	N/A	3	N/A
	mid depth	3.83	N/A	4	N/A
	1m above the seabed	3.73	N/A	7	N/A
C1	1m below the surface	5.78	<b>Lower</b>	6	<b>Lower</b>
	mid depth	6.31	<b>Lower</b>	8	<b>Lower</b>
	1m above the seabed	5.98	<b>Lower</b>	8	<b>Lower</b>
C2	1m below the surface	3.61	<b>Lower</b>	5	<b>Lower</b>
	mid depth	3.38	<b>Lower</b>	4	<b>Lower</b>
	1m above the seabed	3.72	<b>Lower</b>	3	<b>Lower</b>
C3	1m below the surface	3.37	<b>Lower</b>	4	<b>Lower</b>
	mid depth	3.71	<b>Lower</b>	4	<b>Lower</b>
	1m above the seabed	3.63	<b>Lower</b>	4	<b>Lower</b>
C4	1m below the surface	3.34	<b>Lower</b>	3	<b>Lower</b>
	mid depth	3.29	<b>Lower</b>	4	<b>Lower</b>
	1m above the seabed	3.16	<b>Lower</b>	4	<b>Lower</b>
C5	1m below the surface	3.35	N/A	4	N/A
	mid depth	3.55	N/A	4	N/A
	1m above the seabed	3.37	N/A	4	N/A
C6	1m below the surface	3.41	N/A	4	N/A
	mid depth	3.74	N/A	4	N/A
	1m above the seabed	3.31	N/A	4	N/A
C7	1m below the surface	4.89	N/A	4	N/A
	mid depth	4.56	N/A	6	N/A
	1m above the seabed	3.85	N/A	5	N/A

Control Point	Trigger Level for Turbidity in NTU for All Season	Trigger Level for SS in mg/L for Dry Season (October - March)
C1	12.3 for Flood Tide	14.0
C2	12.3 for Flood Tide	
C3	16.9	
C4	10.5 for Ebb Tide	

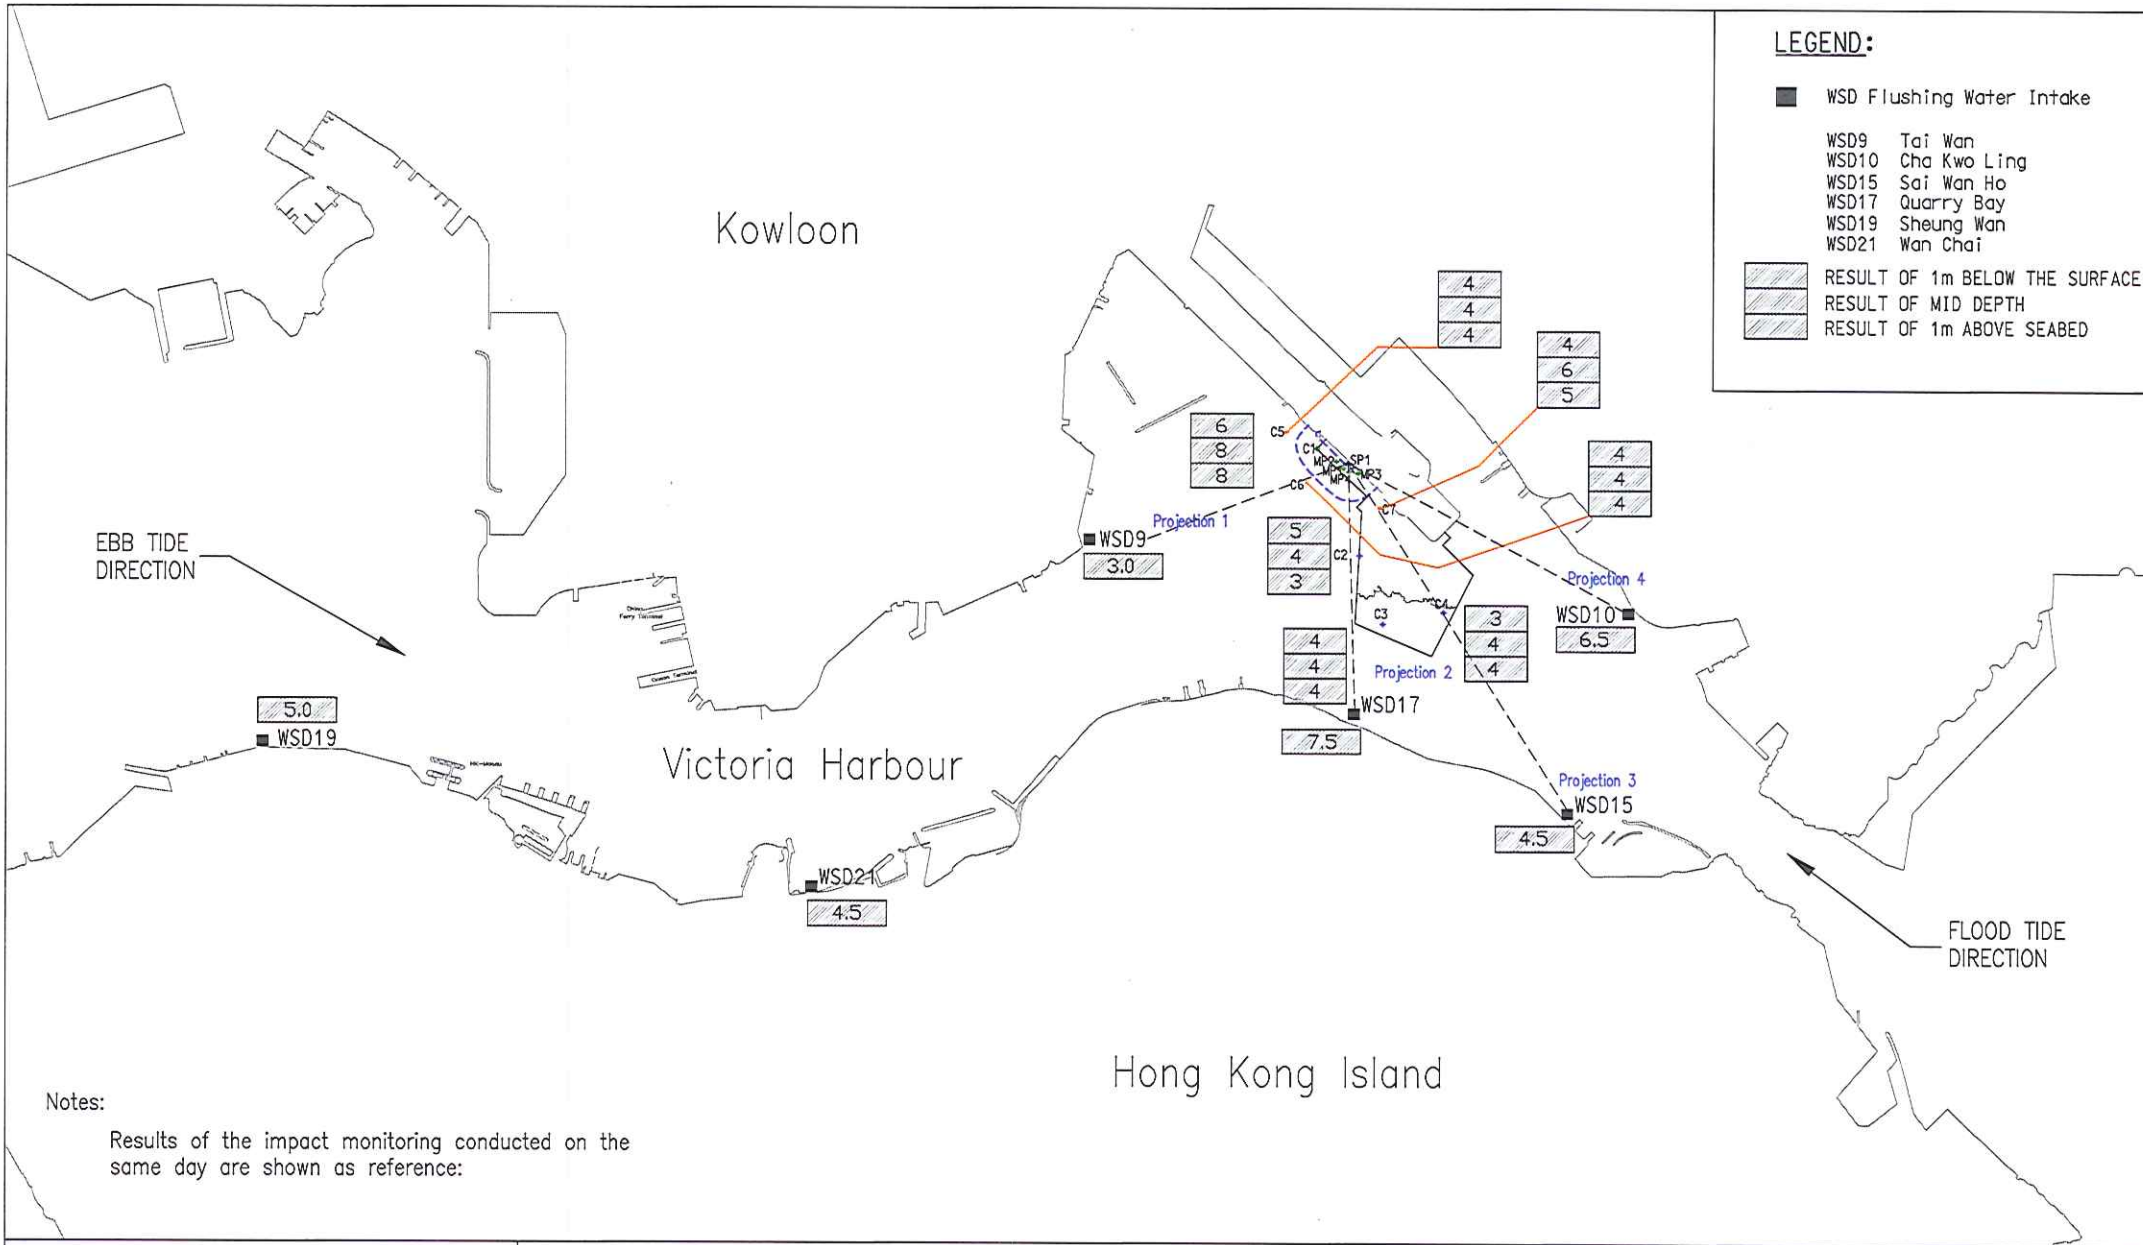

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
WATER QUALITY SURVEILLANCE SYSTEM - (12 Nov 2012 EBB) - Page 1


DATE  
23 Nov 2012

PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0958



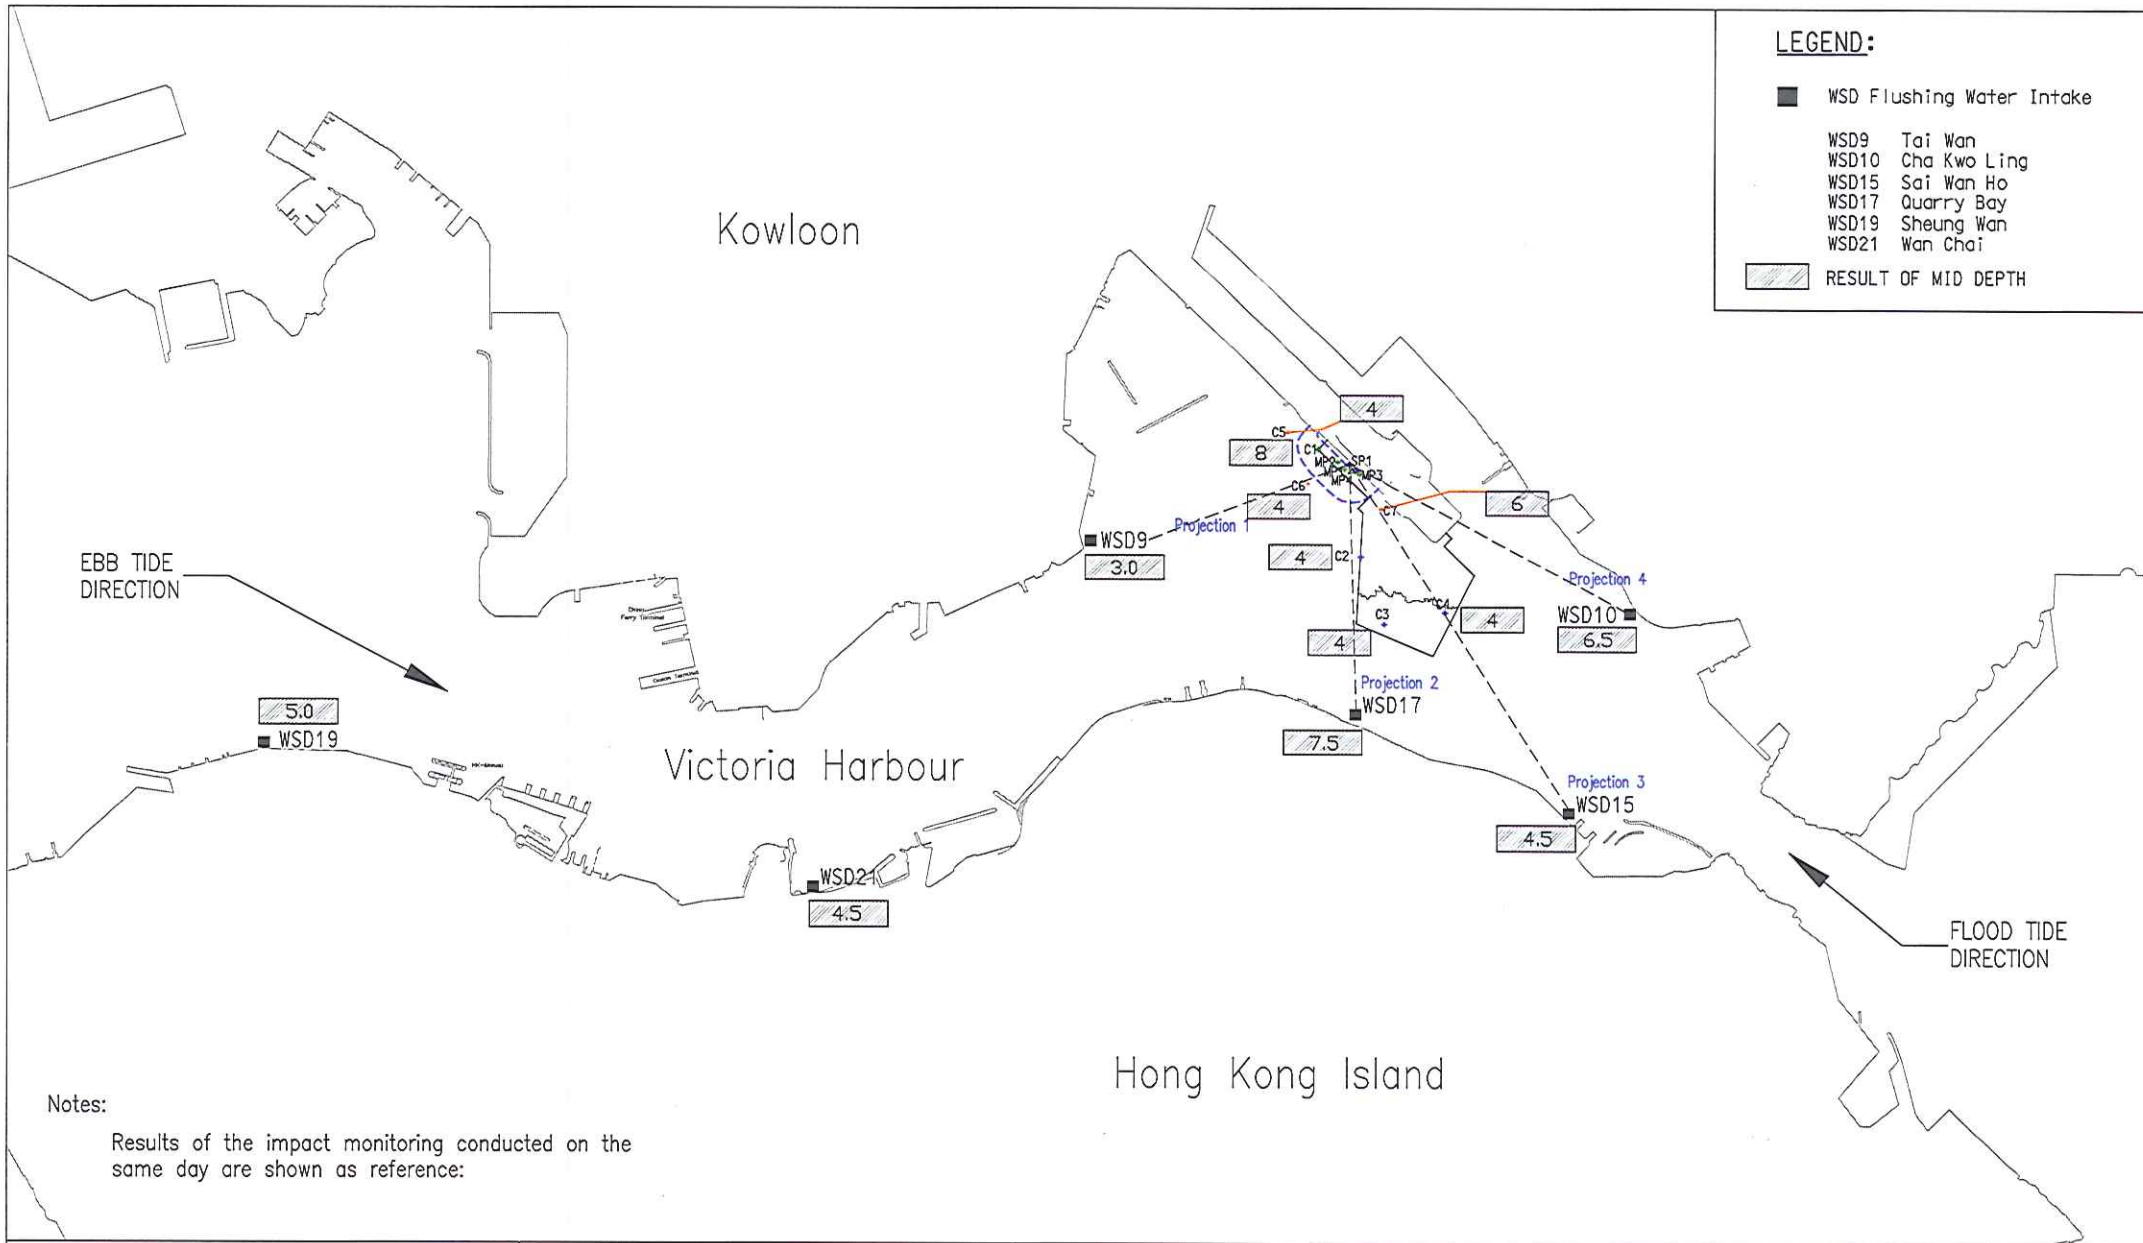

**LEGEND:**

- WSD Flushing Water Intake
- WSD9 Tai Wan
- WSD10 Cha Kwo Ling
- WSD15 Sai Wan Ho
- WSD17 Quarry Bay
- WSD19 Sheung Wan
- WSD21 Wan Chai
- ▨ RESULT OF MID DEPTH

Notes:  
Results of the impact monitoring conducted on the same day are shown as reference:



PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
WATER QUALITY SURVEILLANCE SYSTEM – (12 Nov 2012 EBB) – Page 2

DATE  
23 Nov 2012





PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0959

**Legend**

- Tidal Direction
- Action Level for WSD intake
- Limit Level for WSD intake

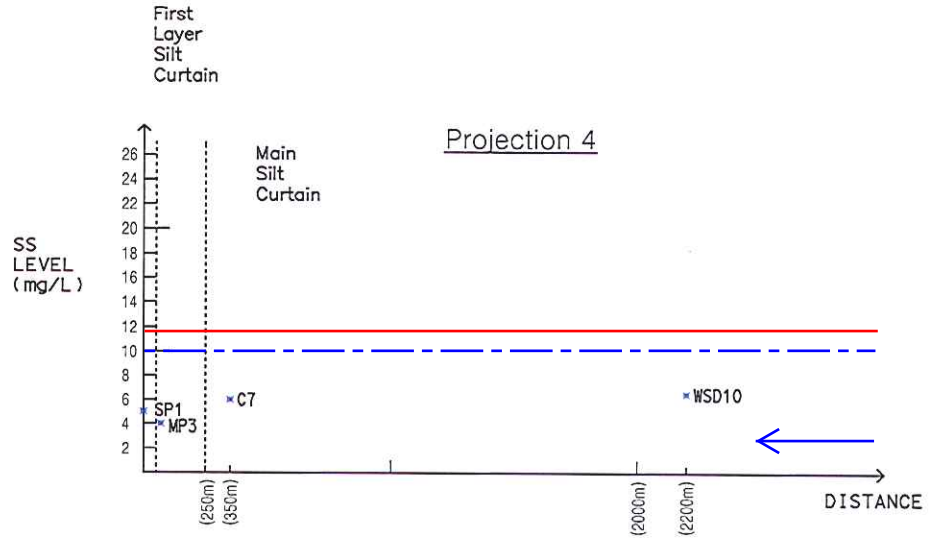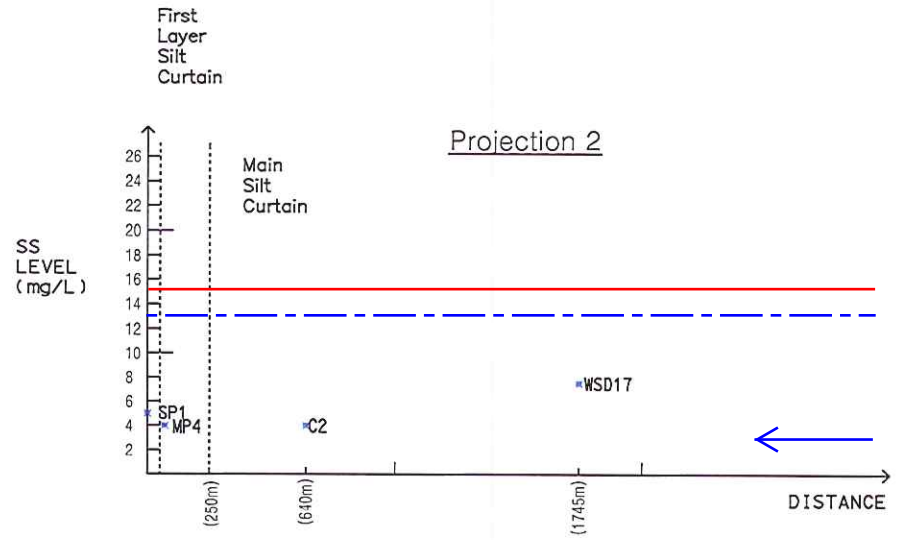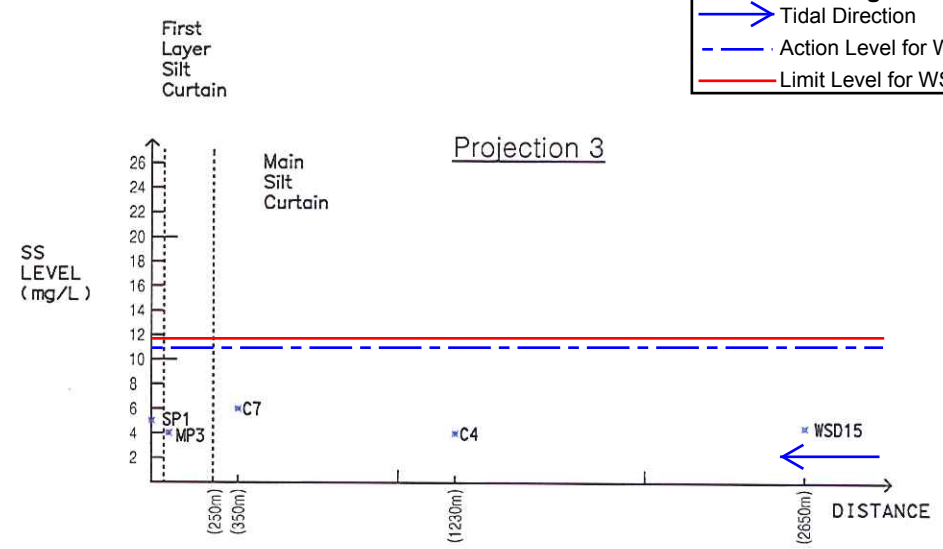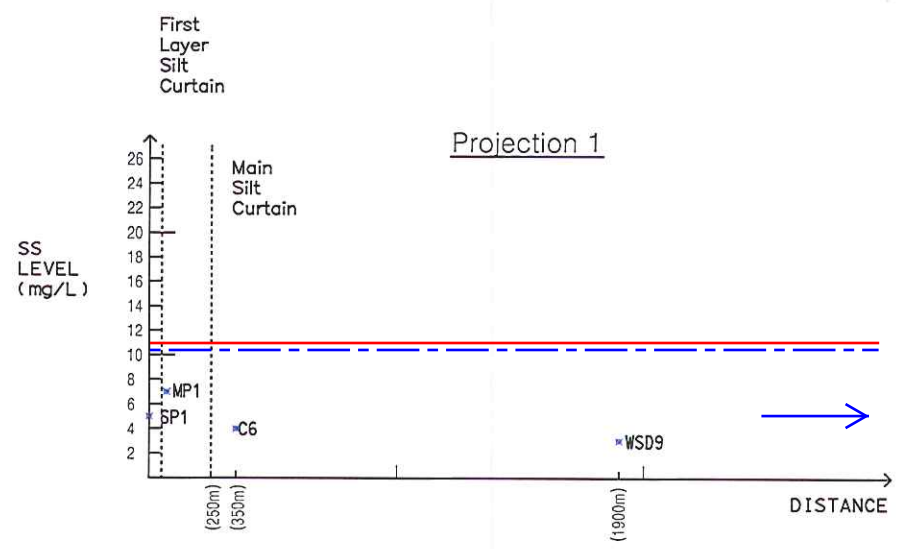

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
GRAPHICAL PRESENTATION OF THE WATER QUALITY SURVEILLANCE SYSTEM MONITORING RESULTS AT MID DEPTH - (12 Nov 2012 EBB)

DATE  
23 Nov 2012

PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0960

Water Quality Surveillance System Monitoring Results - 26 November 2012 (Flood Tide)


Monitoring Location		Turbidity in NTU	Compare to Trigger Level	Suspended Solids in mg/L	Compare to Trigger Level
SP1	1m below the surface	7.07	N/A	8	N/A
	mid depth	8.82	N/A	9	N/A
	1m above the seabed	6.70	N/A	6	N/A
MP1	1m below the surface	2.96	N/A	4	N/A
	mid depth	2.85	N/A	4	N/A
	1m above the seabed	2.42	N/A	3	N/A
MP2	1m below the surface	3.28	N/A	3	N/A
	mid depth	3.01	N/A	4	N/A
	1m above the seabed	3.30	N/A	4	N/A
MP3	1m below the surface	3.82	N/A	<2	N/A
	mid depth	3.30	N/A	3	N/A
	1m above the seabed	3.91	N/A	4	N/A
MP4	1m below the surface	4.11	N/A	2	N/A
	mid depth	3.69	N/A	3	N/A
	1m above the seabed	3.46	N/A	3	N/A
C1	1m below the surface	4.08	<b>Lower</b>	4	<b>Lower</b>
	mid depth	4.44	<b>Lower</b>	4	<b>Lower</b>
	1m above the seabed	4.42	<b>Lower</b>	5	<b>Lower</b>
C2	1m below the surface	2.83	<b>Lower</b>	2	<b>Lower</b>
	mid depth	2.86	<b>Lower</b>	3	<b>Lower</b>
	1m above the seabed	2.90	<b>Lower</b>	4	<b>Lower</b>
C3	1m below the surface	2.53	<b>Lower</b>	3	<b>Lower</b>
	mid depth	2.60	<b>Lower</b>	3	<b>Lower</b>
	1m above the seabed	2.85	<b>Lower</b>	3	<b>Lower</b>
C4	1m below the surface	2.83	<b>Lower</b>	3	<b>Lower</b>
	mid depth	2.96	<b>Lower</b>	2	<b>Lower</b>
	1m above the seabed	2.50	<b>Lower</b>	3	<b>Lower</b>
C5	1m below the surface	4.54	N/A	6	N/A
	mid depth	3.53	N/A	6	N/A
	1m above the seabed	4.48	N/A	6	N/A
C6	1m below the surface	3.11	N/A	3	N/A
	mid depth	2.21	N/A	4	N/A
	1m above the seabed	2.33	N/A	3	N/A
C7	1m below the surface	3.63	N/A	3	N/A
	mid depth	2.97	N/A	3	N/A
	1m above the seabed	3.61	N/A	4	N/A

Control Point	Trigger Level for Turbidity in NTU for All Season	Trigger Level for SS in mg/L for Dry Season (October - March)
C1	12.3 for Flood Tide	14.0
C2	12.3 for Flood Tide	
C3	16.9	
C4	10.5 for Ebb Tide	







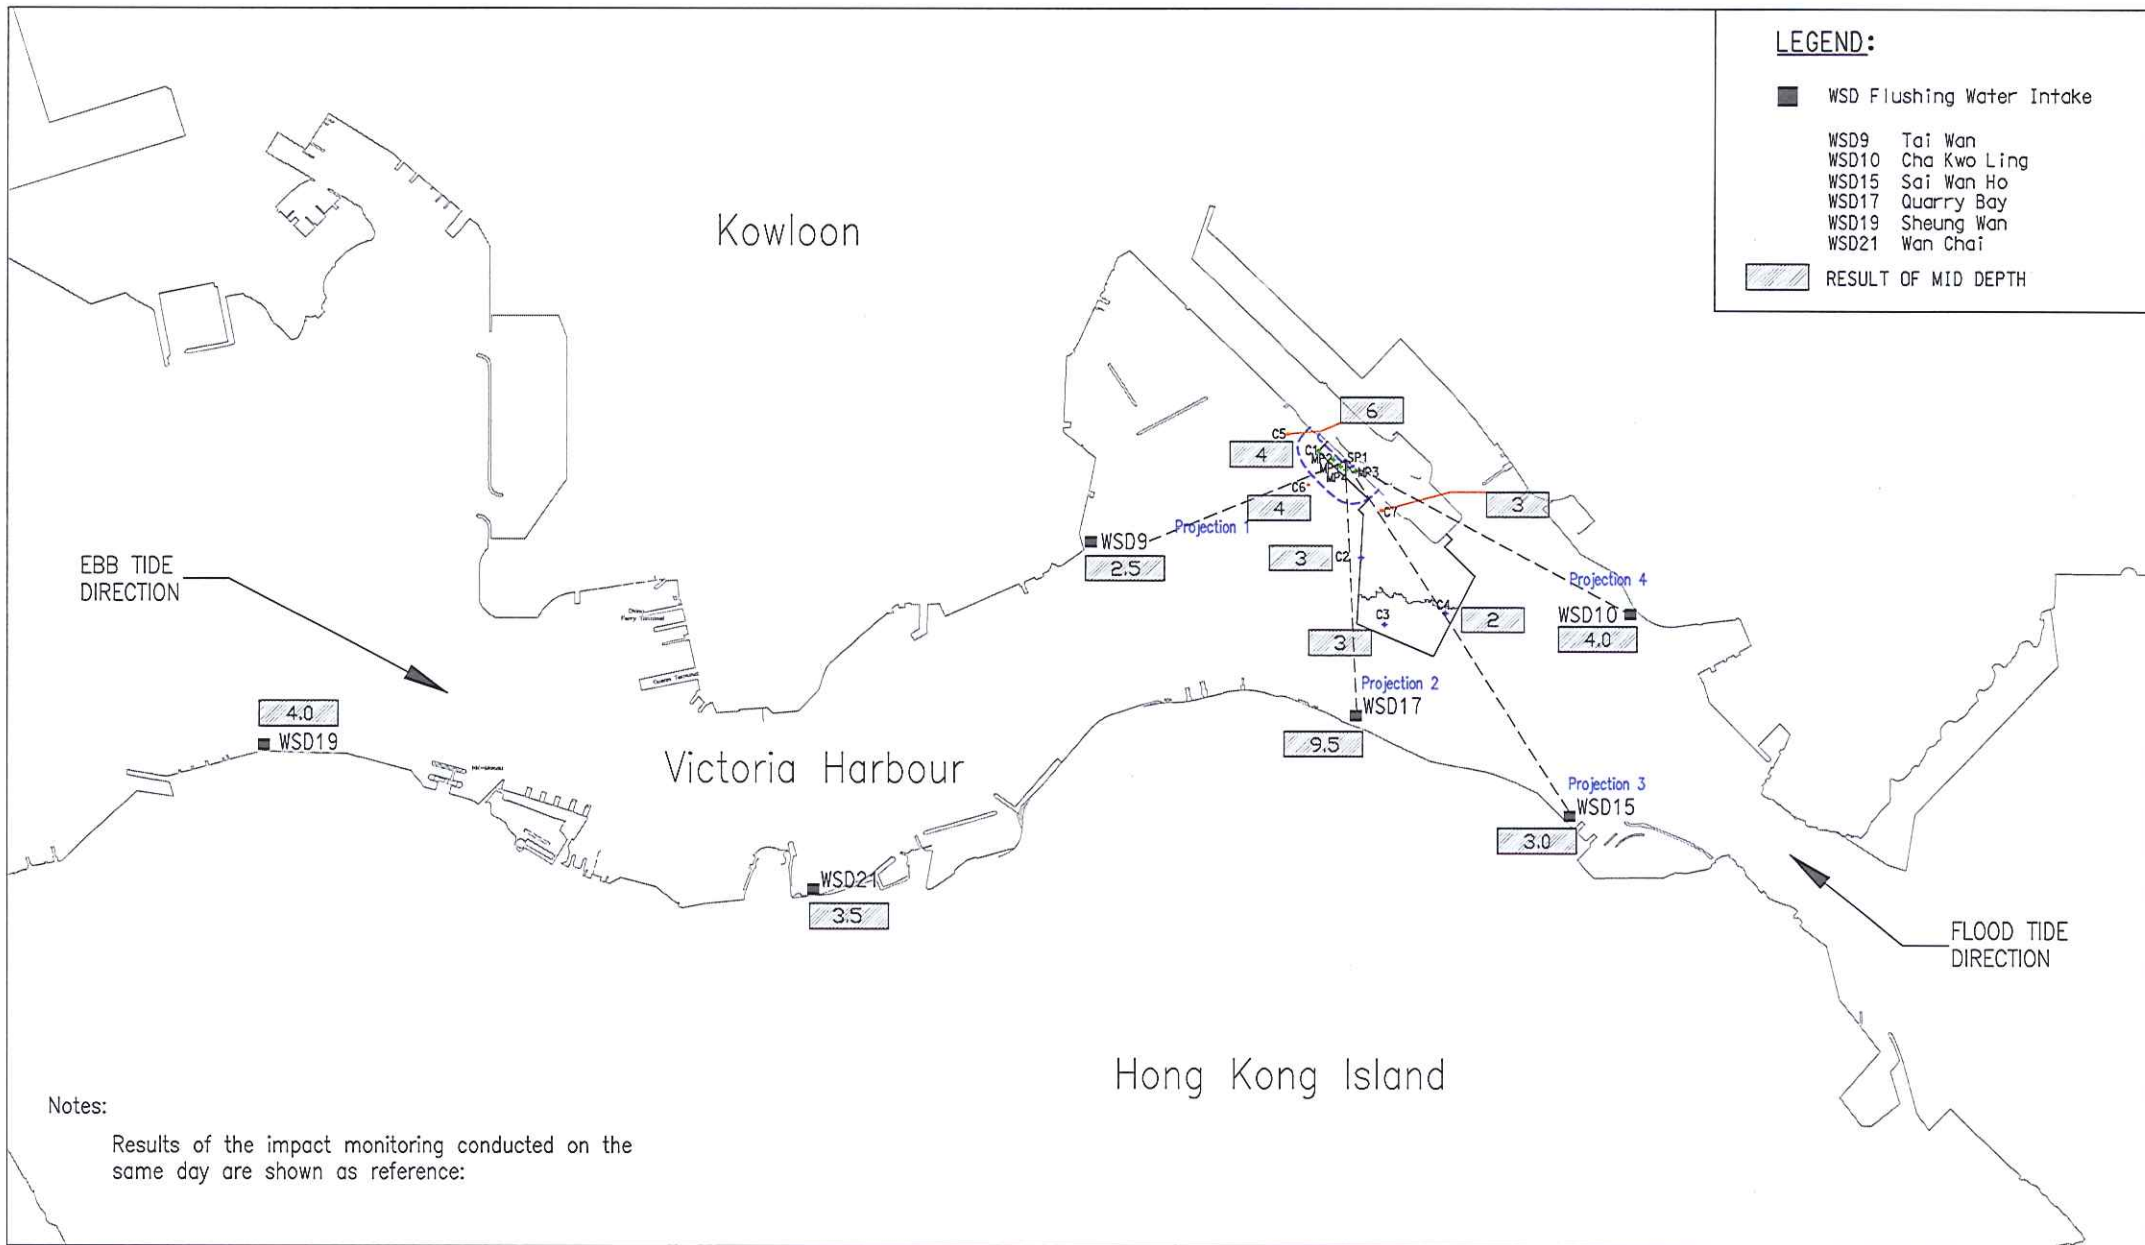

**LEGEND:**

- WSD Flushing Water Intake
- ▨ RESULT OF MID DEPTH
- WSD9 Tai Wan
- WSD10 Cha Kwo Ling
- WSD15 Sai Wan Ho
- WSD17 Quarry Bay
- WSD19 Sheung Wan
- WSD21 Wan Chai





Notes:  
Results of the impact monitoring conducted on the same day are shown as reference:



PROJECT KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development		DATE 5 Dec 2012	PREPARED BY PY
TITLE WATER QUALITY SURVEILLANCE SYSTEM - (26 Nov 2012 FLOOD) - Page 2		SCALE NOT TO SCALE	SKETCH No. SK-0963

**Legend**

- Tidal Direction
- Action Level for WSD intake
- Limit Level for WSD intake

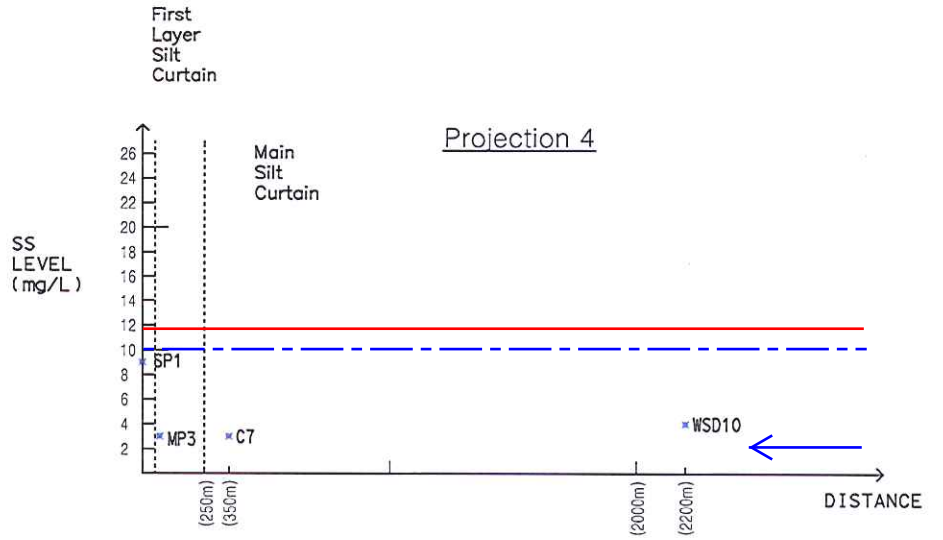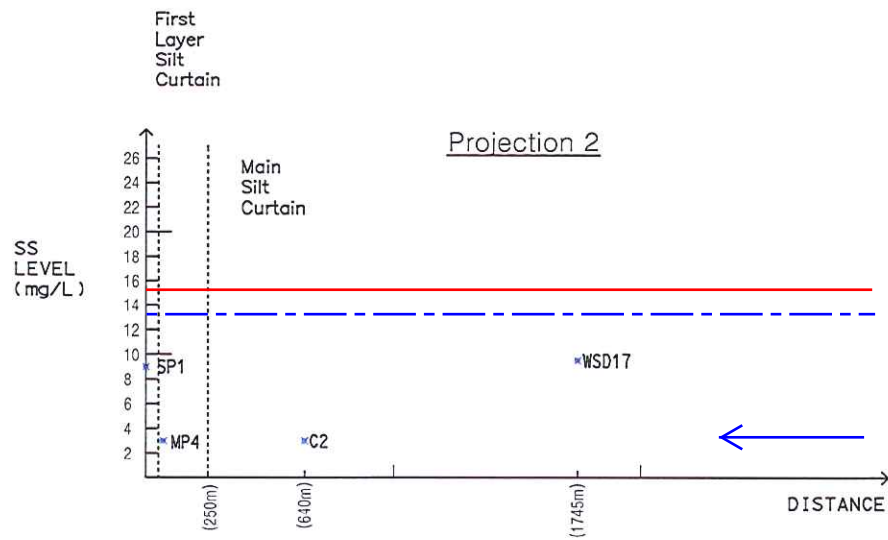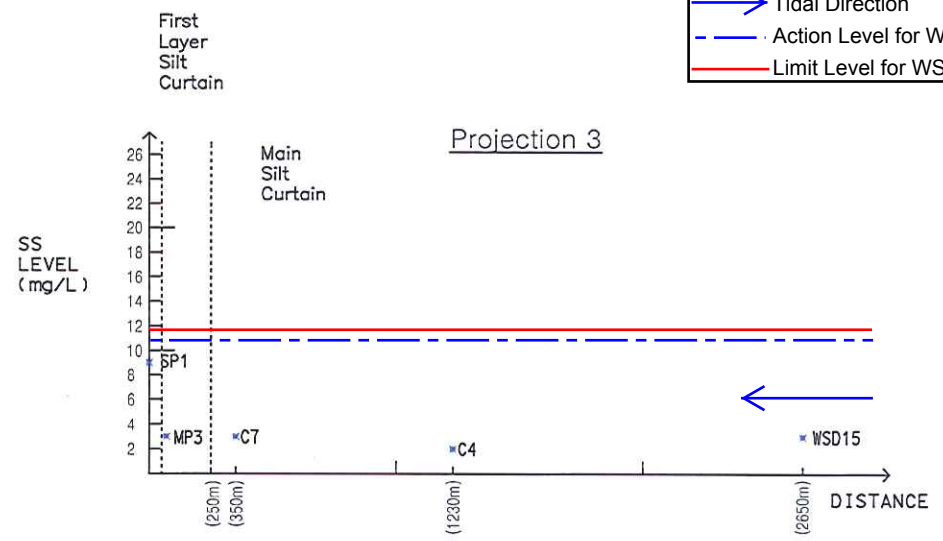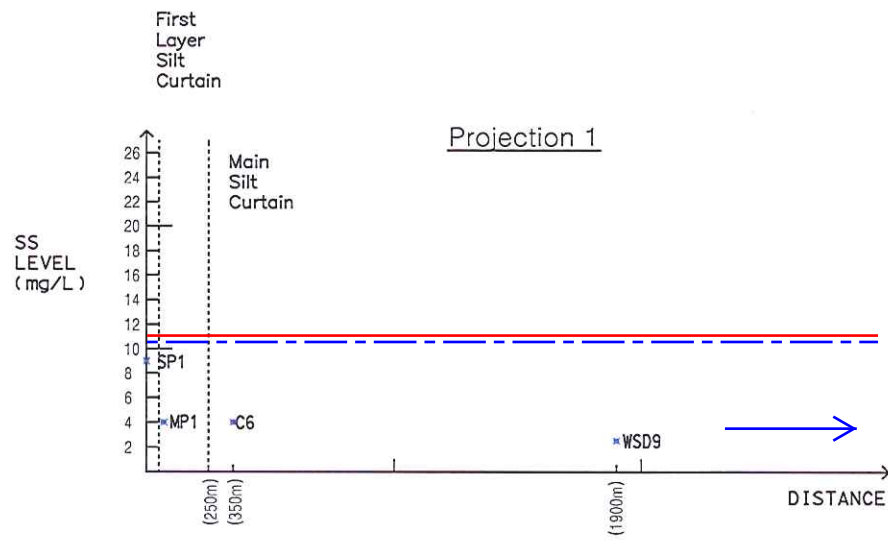

PROJECT  
KL/2009/01 Site Formation for Kai Tak Cruise Terminal Development

TITLE  
GRAPHICAL PRESENTATION OF THE WATER  
QUALITY SURVEILLANCE SYSTEM MONITORING  
RESULTS AT MID DEPTH - (26 Nov 2012 FLOOD)

DATE  
5 Dec 2012

PREPARED BY  
PY

SCALE  
NOT TO SCALE

SKETCH No.  
SK-0964



***Appendix 5.1***

***Event and Action Plan***



**Event and Action Plan for Construction Noise**

EVENT	ACTION			
	ET	IC(E)	ER	CONTRACTOR
Action Level	<ol style="list-style-type: none"> <li>1. Notify IEC and Contractor;</li> <li>2. Carry out investigation;</li> <li>3. Report the results of investigation to the IEC, ER and Contractor;</li> <li>4. Discuss with the Contractor and formulate remedial measures;</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analysed results submitted by the ET;</li> <li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC;</li> <li>2. Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol style="list-style-type: none"> <li>1. Identify source;</li> <li>2. Inform IEC, ER, EPD and Contractor;</li> <li>3. Repeat measurements to confirm findings;</li> <li>4. Increase monitoring frequency;</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>6. Inform IEC, ER and EPD the causes and actions taken for the exceedances;</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>3. Implement the agreed proposals;</li> <li>4. Submit further proposal if problem still not under control;</li> <li>5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated.</li> </ol>



**Event and Action Plan for Marine Water Quality**

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>Repeat in-situ measurement to confirm findings;</li> <li>Identify source(s) of impact;</li> <li>Inform IEC and Contractor;</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Discuss mitigation measures with IEC and Contractor;</li> <li>(The above actions should be taken within 1 working day after the exceedance is identified)</li> <li>Repeat measurement on next day of exceedance.</li> </ol>	<ol style="list-style-type: none"> <li>Discuss with ET and Contractor on the mitigation measures;</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly;</li> <li>Assess the effectiveness of the implemented mitigation measures.</li> <li>(The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>Discuss with IEC on the proposed mitigation measures;</li> <li>Make agreement on the mitigation measures to be implemented.</li> <li>(The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>Inform the ER and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and equipment;</li> <li>Review the working methods and consider additional measures such as use of frame-type silt curtain, deployment of double silt curtains, slowing down, or rescheduling of works;</li> <li>Discuss with ET and IEC and propose mitigation measures to IEC and ER;</li> <li>Implement the agreed mitigation measures.</li> <li>(The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>
Action level being exceeded by more than one consecutive sampling days	<ol style="list-style-type: none"> <li>Identify source(s) of impact;</li> <li>Inform IEC and Contractor;</li> <li>Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>Discuss mitigation measures with IEC and Contractor;</li> </ol>	<ol style="list-style-type: none"> <li>Discuss with ET and Contractor on the mitigation measures;</li> <li>Review proposals on mitigation measures submitted by Contractor and advise the ER</li> </ol>	<ol style="list-style-type: none"> <li>Discuss with IEC on the proposed mitigation measures;</li> <li>Make agreement on the mitigation measures to be implemented;</li> <li>Assess the effectiveness</li> </ol>	<ol style="list-style-type: none"> <li>Inform the Engineer and confirm notification of the non-compliance in writing;</li> <li>Rectify unacceptable practice;</li> <li>Check all plant and</li> </ol>





EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
	<ul style="list-style-type: none"><li>5. Ensure mitigation measures are implemented;</li><li>6. Prepare to increase the monitoring frequency to daily;</li><li>7. (The above actions should be taken within 1 working day after the exceedance is identified)</li><li>8. Repeat measurement on next working day of exceedance.</li></ul>	<ul style="list-style-type: none"><li>3. Assess the effectiveness of the implemented mitigation measures.</li><li>4. (The above actions should be taken within 1 working day after the exceedance is identified)</li></ul>	<ul style="list-style-type: none"><li>of the implemented mitigation measures.</li><li>4. (The above actions should be taken within 1 working day after the exceedance is identified)</li></ul>	<ul style="list-style-type: none"><li>equipment;</li><li>4. Review the working methods and consider additional measures such as use of frame-type silt curtain, deployment of double silt curtains, slowing down, or rescheduling of works;</li><li>5. Discuss with ET and IEC and propose mitigation measures to IEC and ER within 3 working days;</li><li>6. Implement the agreed mitigation measures.</li><li>7. (The above actions should be taken within 1 working day after the exceedance is identified)</li></ul>



EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Inform IEC, Contractor and EPD;</li> <li>4. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>5. Discuss mitigation measures with IEC, ER and Contractor;</li> <li>6. Ensure mitigation measures are implemented;</li> <li>7. Increase the monitoring frequency to daily until no exceedance of Limit Level.</li> <li>8. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with ET and Contractor on the mitigation measures;</li> <li>2. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly;</li> <li>3. Assess the effectiveness of the implemented mitigation measures.</li> <li>4. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>2. Request Contractor to critically review the working methods;</li> <li>3. Make agreement on the mitigation measures to be implemented;</li> <li>4. Assess the effectiveness of the implemented mitigation measures.</li> <li>5. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the Engineer and confirm notification of the non-compliance in writing;</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Review the working methods and consider additional measures such as use of frame-type silt curtain, deployment of double silt curtains, slowing down, or rescheduling of works;</li> <li>5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days;</li> <li>6. Implement the agreed mitigation measures.</li> <li>7. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>



EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Limit level being exceeded by more than one consecutive sampling days	<ol style="list-style-type: none"> <li>1. Identify source(s) of impact;</li> <li>2. Inform IEC, Contractor and EPD;</li> <li>3. Check monitoring data, all plant, equipment and Contractor's working methods;</li> <li>4. Discuss mitigation measures with IEC, ER and Contractor;</li> <li>5. Ensure mitigation measures are implemented;</li> <li>6. Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days.</li> <li>7. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with ET and Contractor on the mitigation measures;</li> <li>2. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly;</li> <li>3. Assess the effectiveness of the implemented mitigation measures.</li> <li>4. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with IEC, ET and Contractor on the proposed mitigation measures;</li> <li>2. Request Contractor to critically review the working methods;</li> <li>3. Make agreement on the mitigation measures to be implemented;</li> <li>4. Assess the effectiveness of the implemented mitigation measures;</li> <li>5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit level.</li> <li>6. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the ER and confirm notification of the non-compliance in writing;</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant and equipment;</li> <li>4. Review the working methods and consider additional measures such as use of frame-type silt curtain, deployment of double silt curtains, slowing down, or rescheduling of works;</li> <li>5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days;</li> <li>6. Implement the agreed mitigation measures;</li> <li>7. As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities.</li> <li>8. (The above actions should be taken within 1 working day after the exceedance is identified)</li> </ol>





***Appendix 5.2***

***Graphic Presentation of SS Results against to Tidal Movement along Victoria Harbour***



Contract no. KL/2009/01

Site Formation for Kai Tak Cruise Terminal Development  
 Summary of Recorded Exceedances in Reporting Quarter


Date	Tide	Station	Parameter	Exceedance	Turbidity (NTU) / SS	Possible Cause of Exceedance	Turbidity (NTU) / SS (mg/L) value in the nearest upstream station
5/9/2012	Mid-ebb	WSD10	Turbidity (NTU)	AL	10.0	Localized impact or changes in ambient conditions	WSD17: 4.03 and WSD15: 4.61
10/9/2012	Mid-ebb	WSD10	SS(mg/L)	LL	14.0	Localized impact or changes in ambient conditions	WSD17: 2.5 and WSD15: 2.5
28/9/2012	Mid-flood	WSD10	Turbidity (NTU)	AL	9.3	Upstream of the Project	N/A
28/9/2012	Mid-flood	WSD17	SS(mg/L)	AL	17.0	Upstream of the Project	N/A
2/10/2012	Mid-flood	WSD9	Turbidity (NTU)	AL	6.5	Localized impact or changes in ambient conditions	WSD17: 6.8 and WSD21: 2.6
2/10/2012	Mid-flood	WSD10	Turbidity (NTU)	AL	7.3	Upstream of the Project	N/A
2/10/2012	Mid-ebb	WSD10	SS (mg/L) / Turbidity (NTU)	LL / AL	12.0mg/L / 8.6 NTU	Localized impact or changes in ambient conditions	SS - WSD17: 14.5 and WSD15: 11.0 Turbidity - WSD17: 10.0 and WSD15: 8.2
2/10/2012	Mid-ebb	WSD15	SS (mg/L) / Turbidity (NTU)	AL	11.0mg/L / 8.2 NTU	Localized impact or changes in ambient conditions	SS - WSD17: 14.5 and WSD10: 12.0 Turbidity - WSD17: 6.8 and WSD10: 8.6
2/10/2012	Mid-ebb	WSD17	SS(mg/L)	AL	14.5	Localized impact or changes in ambient conditions	WSD10: 12.0 and WSD15: 11.0
2/10/2012	Mid-ebb	WSD19	SS (mg/L) / Turbidity (NTU)	LL / AL	21.5mg/L / 13.8 NTU	Upstream of the Project	N/A
4/10/2012	Mid-flood	WSD15	SS (mg/L) / Turbidity (NTU)	LL / AL	15.5mg/L / 9.5 NTU	Upstream of the Project	N/A
4/10/2012	Mid-flood	WSD17	SS (mg/L) / Turbidity (NTU)	LL	15.5mg/L / 17.6 NTU	Upstream of the Project	N/A
13/10/2012	Mid-flood	WSD15	SS(mg/L)	LL	13.5	Upstream of the Project	N/A
13/10/2012	Mid-flood	WSD17	SS(mg/L)	AL	14.0	Upstream of the Project	N/A
15/10/2012	Mid-flood	WSD15	SS(mg/L)	LL	12.0	Upstream of the Project	N/A
17/10/2012	Mid-flood	WSD9	Turbidity (NTU)	AL	6.5	Localized impact or changes in ambient conditions	WSD17: 7.0 and WSD21: 3.9
17/10/2012	Mid-flood	WSD15	SS (mg/L) / Turbidity (NTU)	AL	11.5mg/L / 9.8NTU	Upstream of the Project	N/A
17/10/2012	Mid-flood	WSD19	Turbidity (NTU)	AL	12.2	Localized impact or changes in ambient conditions	WSD9: 6.5 and WSD21: 3.9
20/10/2012	Mid-flood	WSD9	Turbidity (NTU)	AL	6.9	Localized impact or changes in ambient conditions	WSD17: 11.3 and WSD21: 5.6
20/10/2012	Mid-ebb	WSD9	Turbidity (NTU)	AL	6.7	Upstream of the Project	N/A
20/10/2012	Mid-flood	WSD10	SS(mg/L)	LL	15.5	Upstream of the Project	N/A
20/10/2012	Mid-flood	WSD17	SS (mg/L) / Turbidity (NTU)	LL / AL	16.5mg/L / 11.3NTU	Upstream of the Project	N/A
22/10/2012	Mid-flood	WSD10	SS (mg/L) / Turbidity (NTU)	LL / AL	16mg/L / 9.1NTU	Upstream of the Project	N/A
22/10/2012	Mid-ebb	WSD15	Turbidity (NTU)	AL	9.8	Localized impact or changes in ambient conditions	WSD17: 6.2 and WSD10: 4.3
22/10/2012	Mid-flood	WSD15	SS(mg/L)	LL	17.0	Upstream of the Project	N/A
22/10/2012	Mid-flood	WSD19	SS(mg/L)	LL	20.5	Localized impact or changes in ambient conditions	WSD9: 10.0 and WSD21: 3.5
27/10/2012	Mid-flood	WSD10	SS(mg/L)	LL	12.5	Upstream of the Project	N/A
29/10/2012	Mid-flood	WSD9	Turbidity (NTU)	AL	8.0	Localized impact or changes in ambient conditions	WSD17: 8.5 and WSD21: 2.0
29/10/2012	Mid-flood	WSD15	SS (mg/L) / Turbidity (NTU)	AL	11.5mg/L / 9.4NTU	Upstream of the Project	N/A
31/10/2012	Mid-flood	WSD9	Turbidity (NTU)	AL	6.7	Localized impact or changes in ambient conditions	WSD17: 12.4 and WSD21: 4.6
31/10/2012	Mid-ebb	WSD9	Turbidity (NTU)	AL	6.4	Upstream of the Project	N/A
31/10/2012	Mid-flood	WSD10	SS(mg/L)	LL	12.5	Upstream of the Project	N/A
31/10/2012	Mid-ebb	WSD10	SS(mg/L)	AL	11.0	Localized impact or changes in ambient conditions	WSD15: 8.0 and WSD17: 8.5
31/10/2012	Mid-flood	WSD15	SS(mg/L)	LL	12.5	Upstream of the Project	N/A
31/10/2012	Mid-flood	WSD17	SS (mg/L) / Turbidity (NTU)	LL / AL	18mg/L / 12.4NTU	Upstream of the Project	N/A
31/10/2012	Mid-flood	WSD19	SS(mg/L)	AL	16.5	Upstream of the Project	N/A
2/11/2012	Mid-flood	WSD10	SS (mg/L) / Turbidity (NTU)	AL	12.0mg/L / 7.6NTU	Upstream of the Project	N/A
3/11/2012	Mid-ebb	WSD10	Turbidity (NTU)	AL	7.1	Upstream of the Project	N/A
8/11/2012	Mid-flood	WSD10	SS(mg/L)	LL	15.5	Upstream of the Project	N/A
10/11/2012	Mid-flood	WSD21	SS(mg/L)	LL	14.5	Upstream of the Project	N/A
10/11/2012	Mid-flood	WSD10	SS(mg/L)	LL	18.0	Upstream of the Project	N/A
12/11/2012	Mid-flood	WSD17	SS (mg/L) / Turbidity (NTU)	LL / AL	19.0mg/L / 12.6NTU	Upstream of the Project	N/A
14/11/2012	Mid-flood	WSD9	Turbidity (NTU)	AL	6.3	Localized impact or changes in ambient conditions	WSD17: 8.5 and WSD21: 4.0
17/11/2012	Mid-flood	WSD17	SS(mg/L)	AL	13.5	Upstream of the Project	N/A
29/11/2012	mid-ebb	WSD9	Turbidity (NTU)	AL	6.5	Upstream of the Project	N/A




### Graphic Presentation of SS Results Against the Tidal Movement along Victoria Harbour

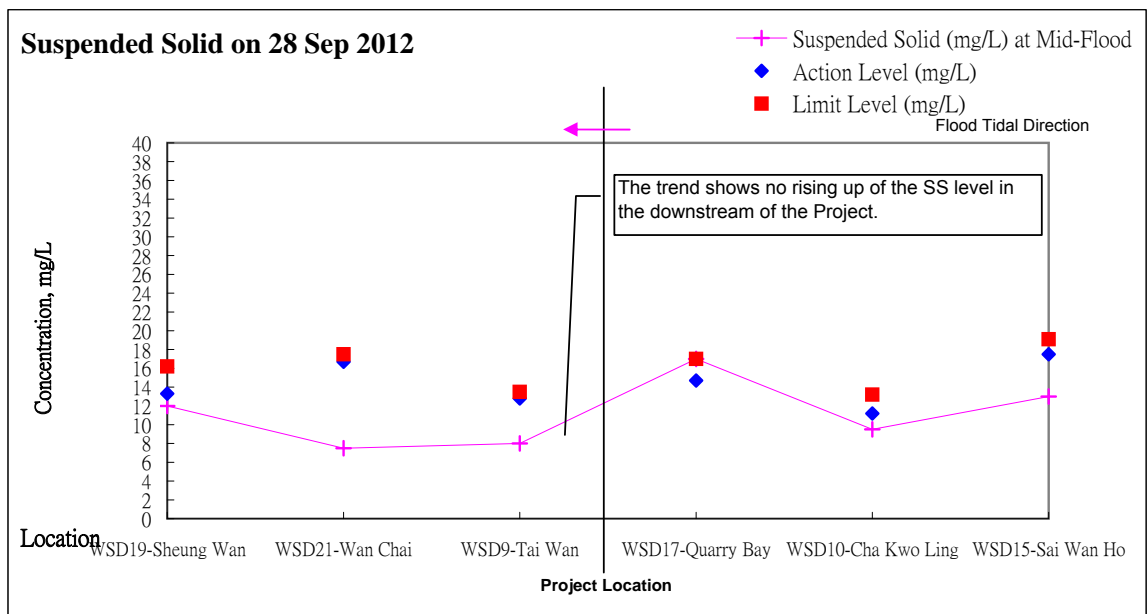
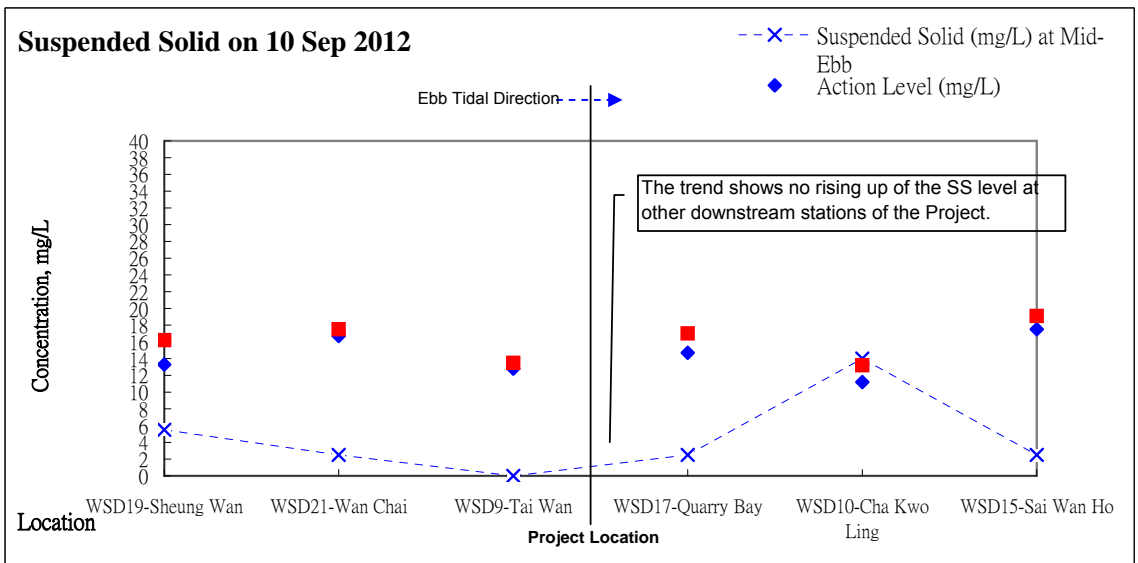




### Suspended Solid on 2 Oct 2012

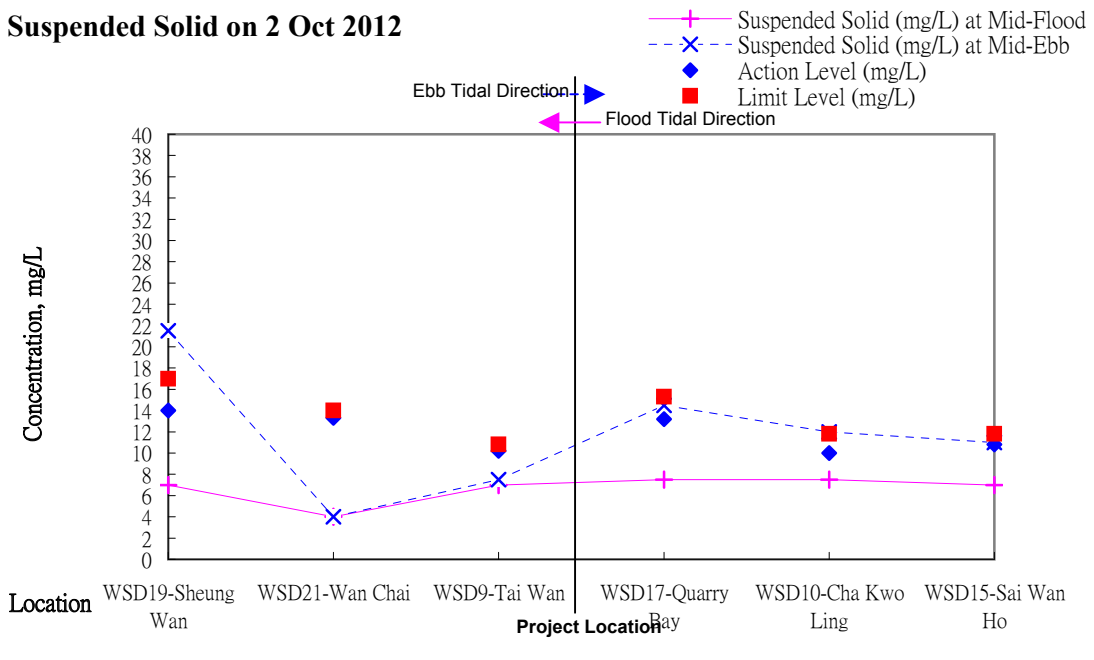


### Suspended Solid on 4 Oct 2012

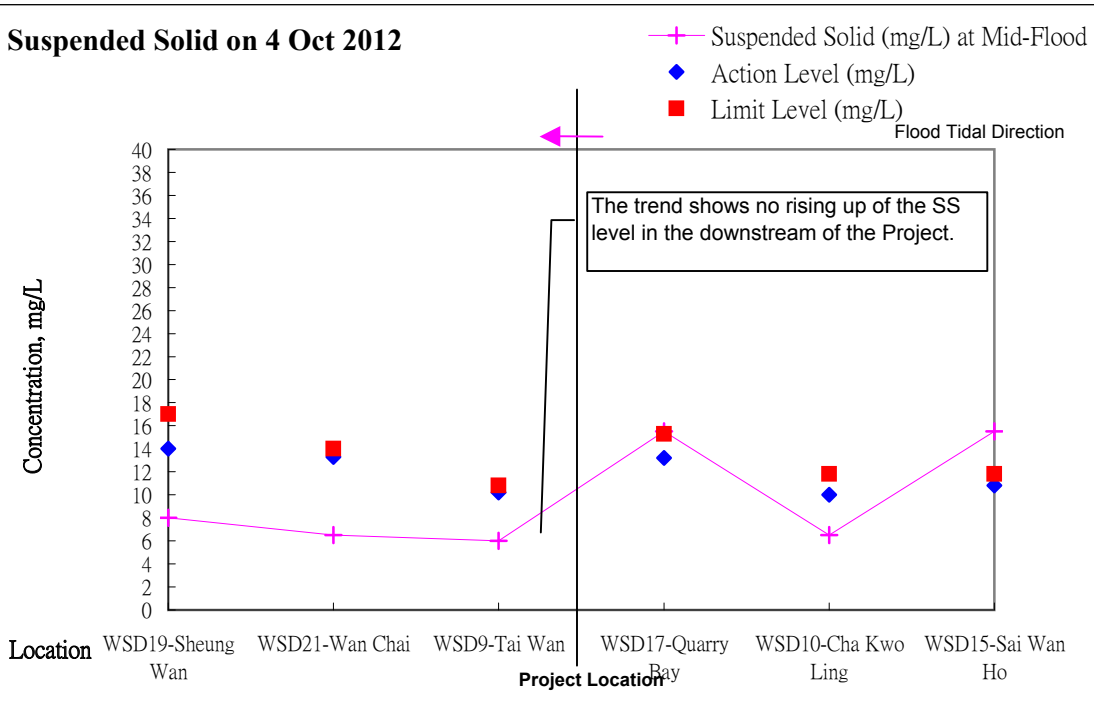

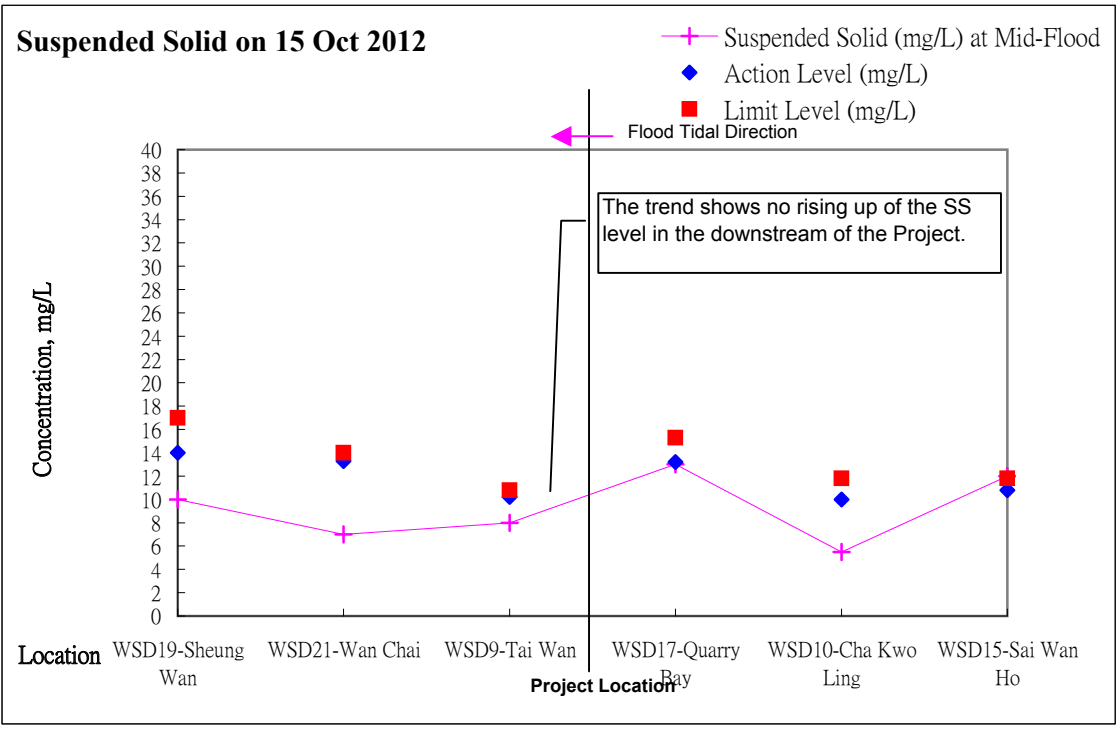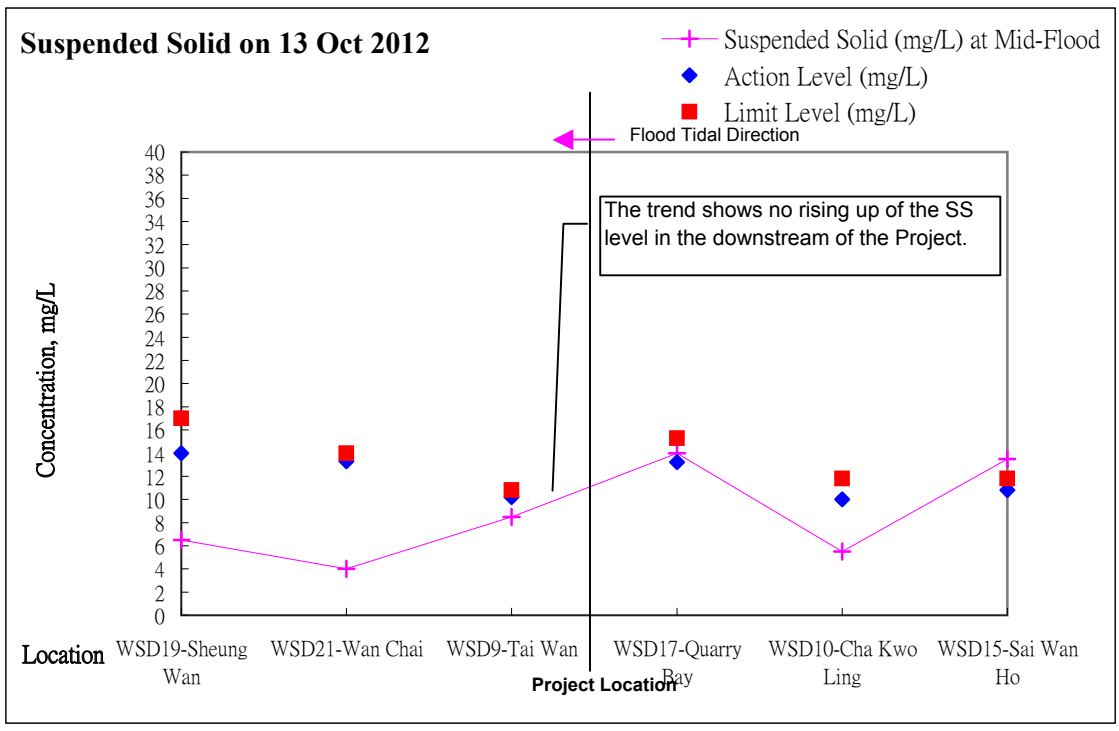


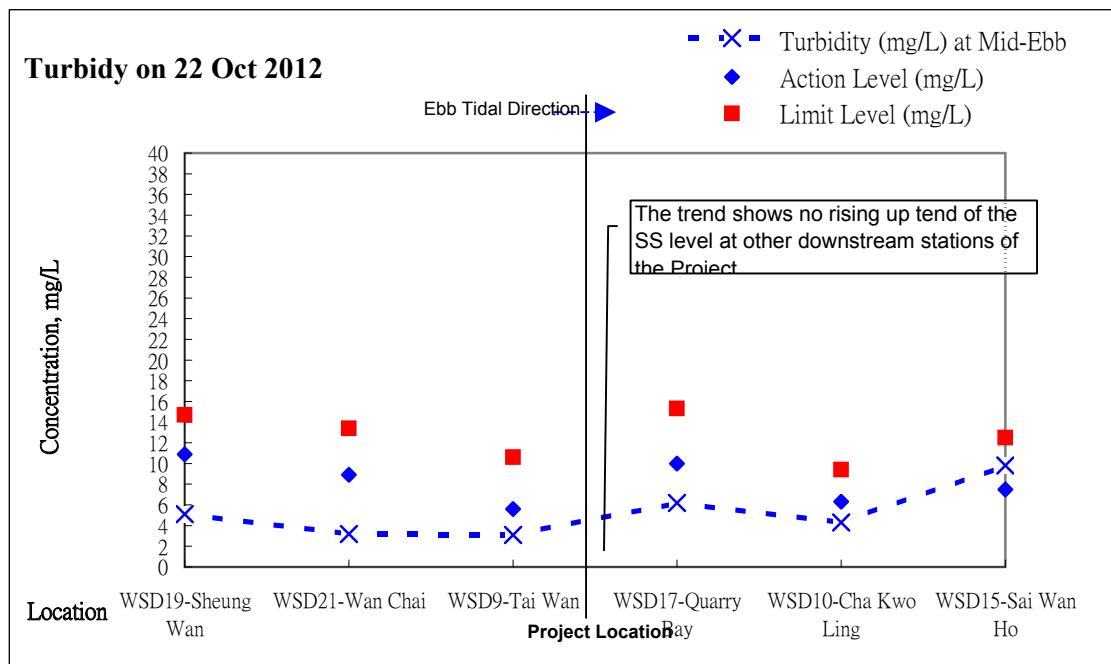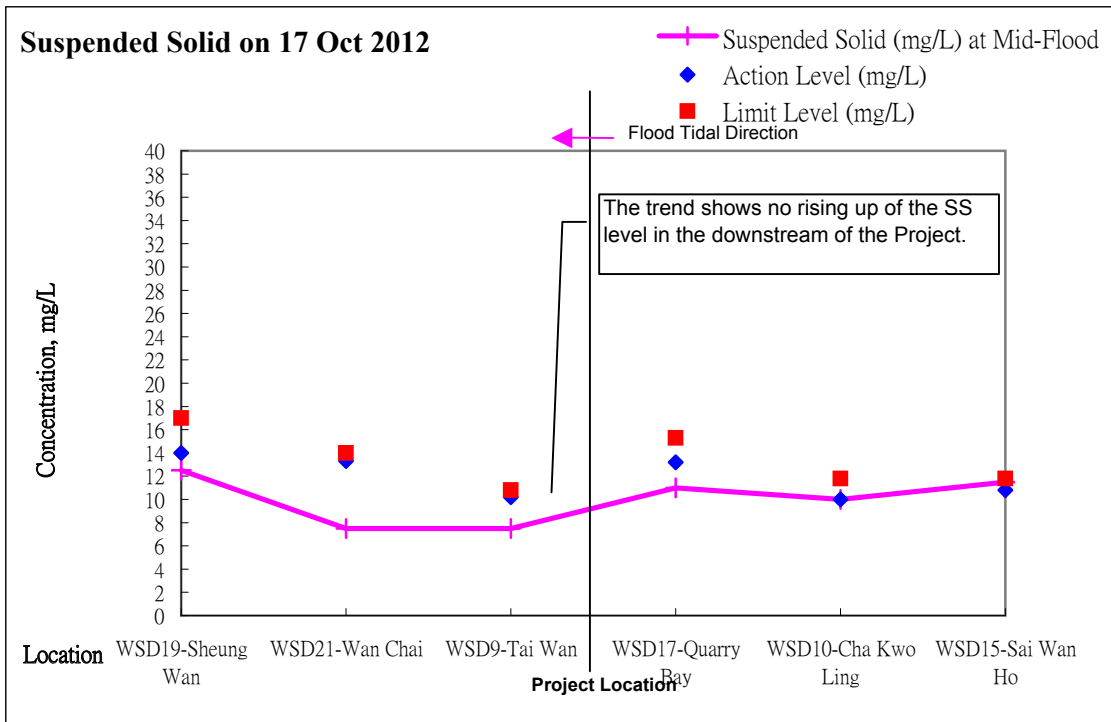

### Suspended Solid on 20 Oct 2012

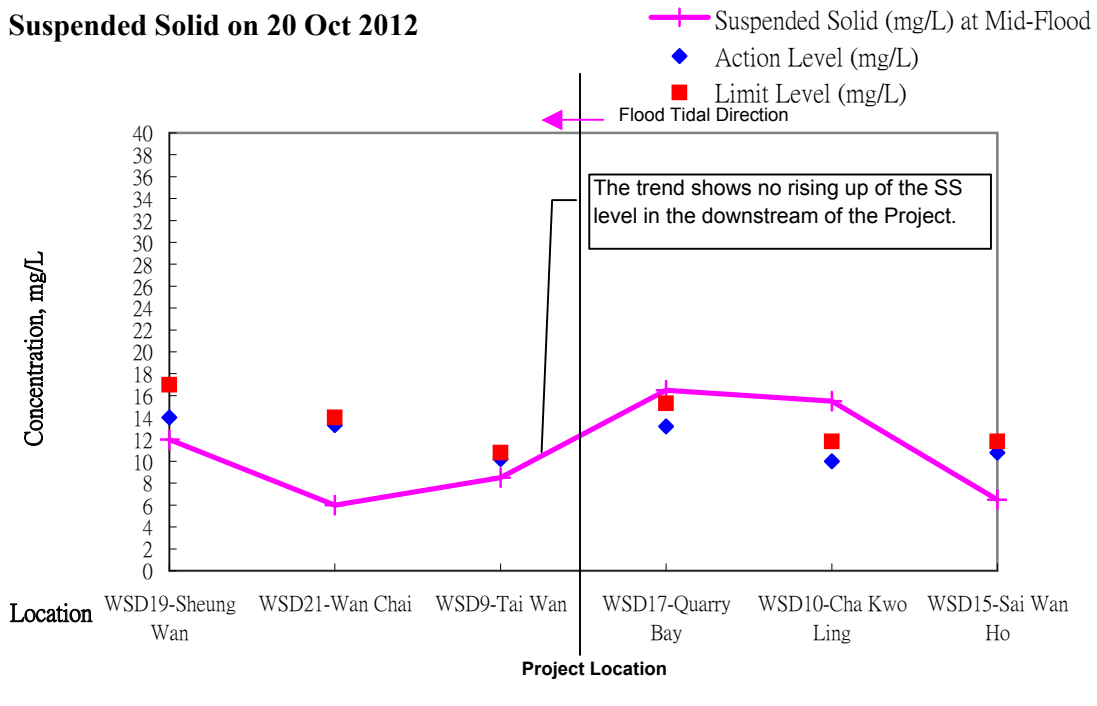


### Suspended Solid on 22 Oct 2012

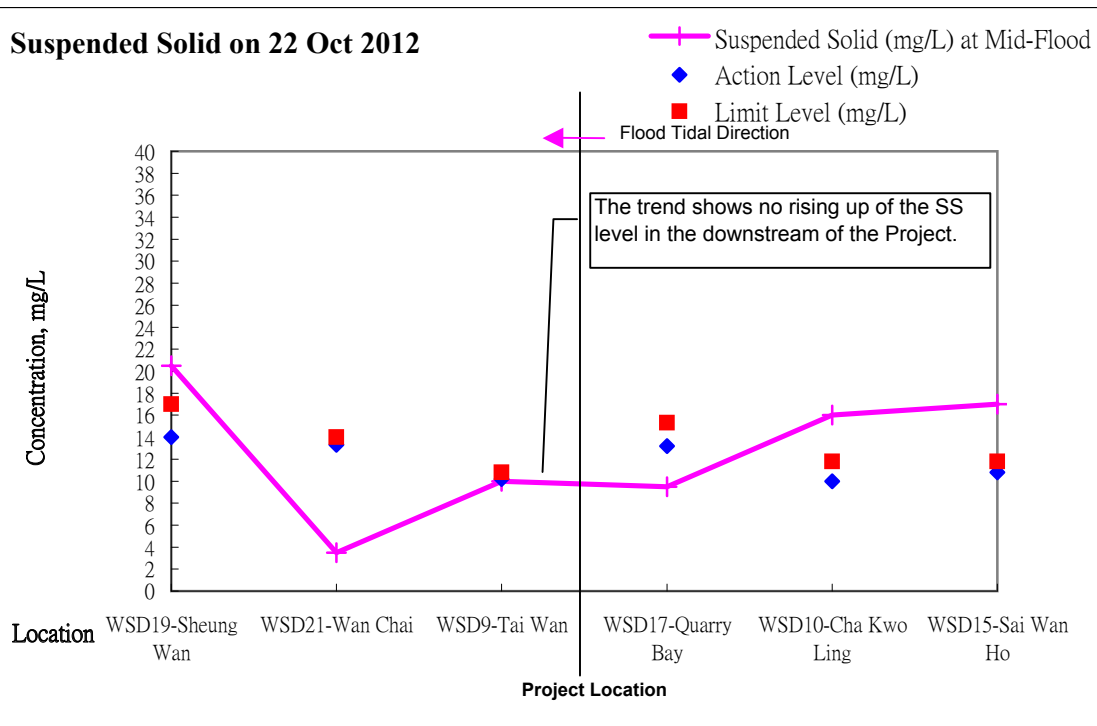






### Suspended Solid on 27 Oct 2012

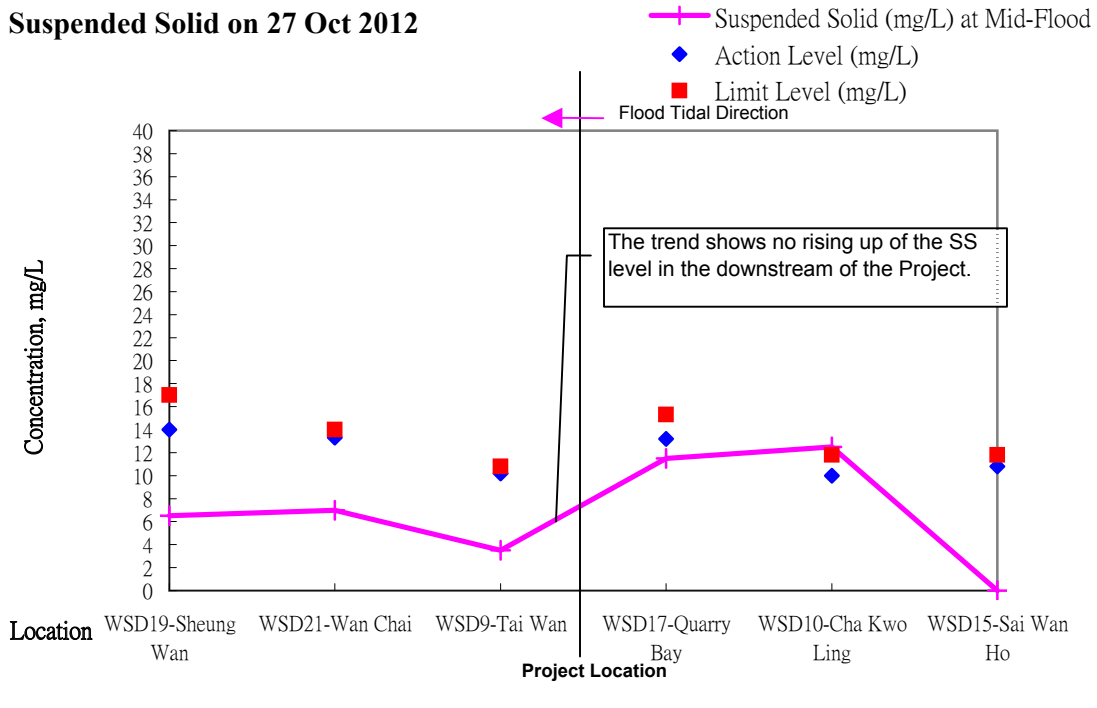



### Suspended Solid on 29 Oct 2012

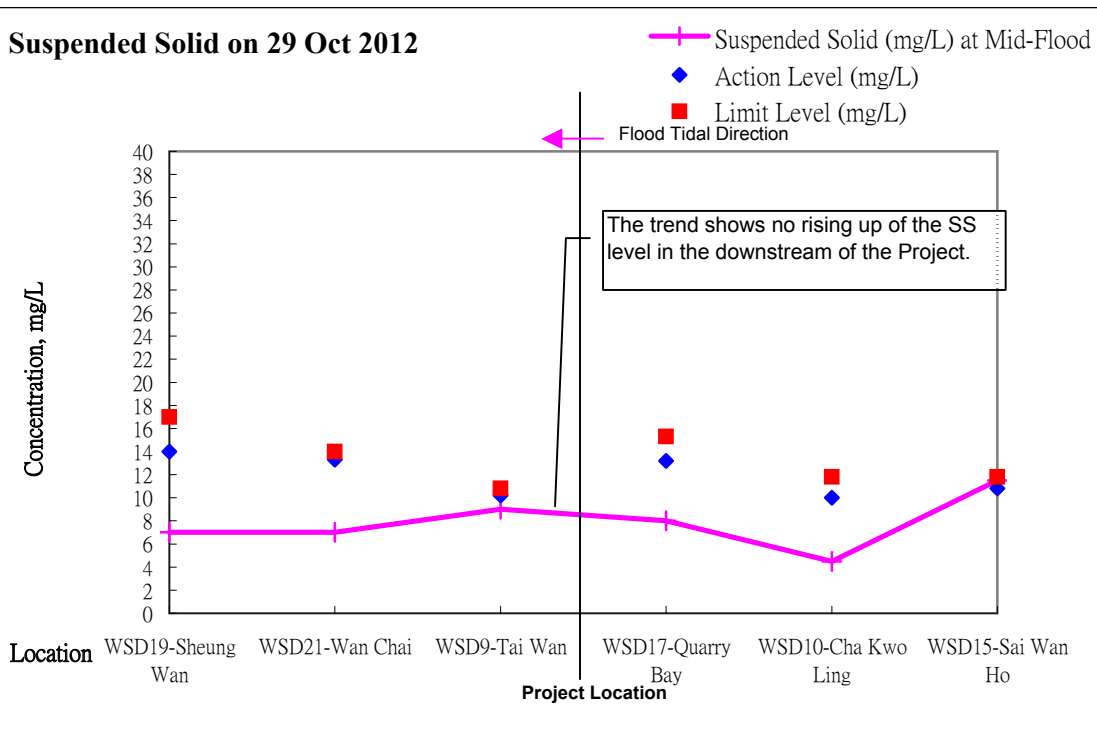

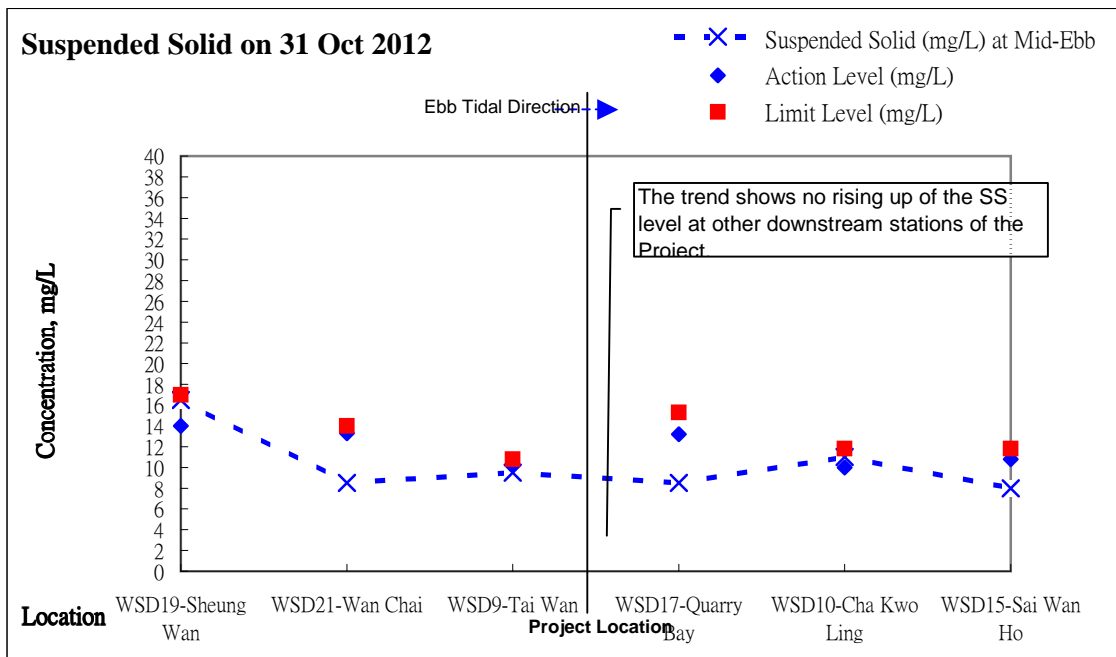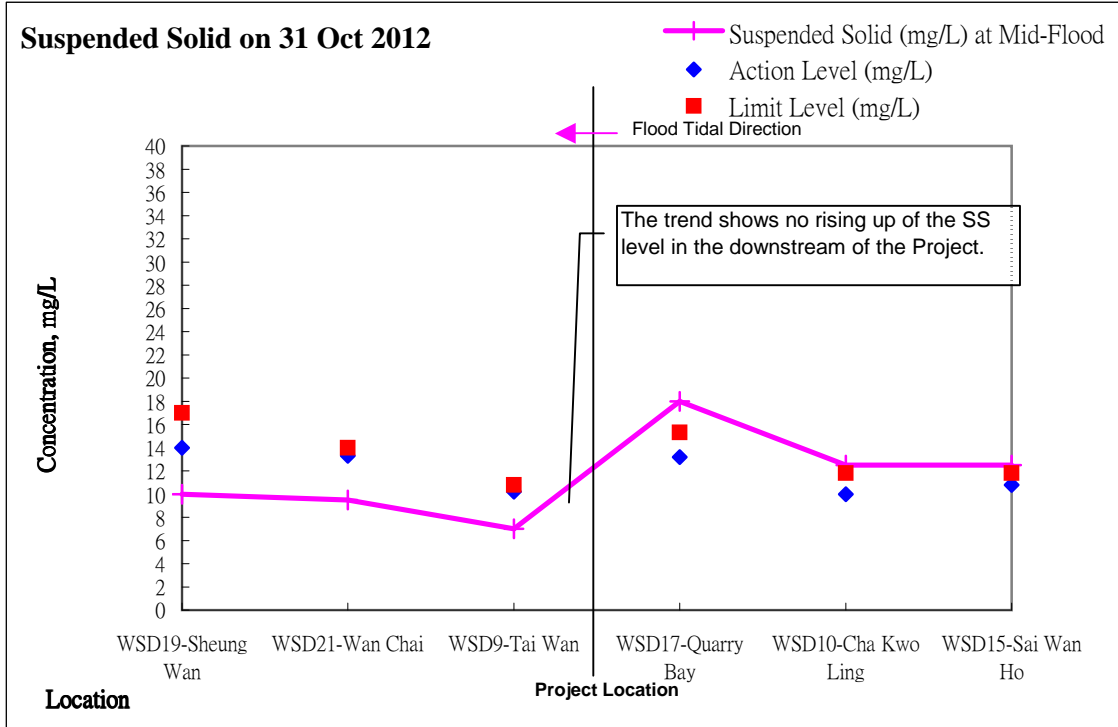







### Graphic Presentation of SS Results Against the Tidal Movement along Victoria Harbour

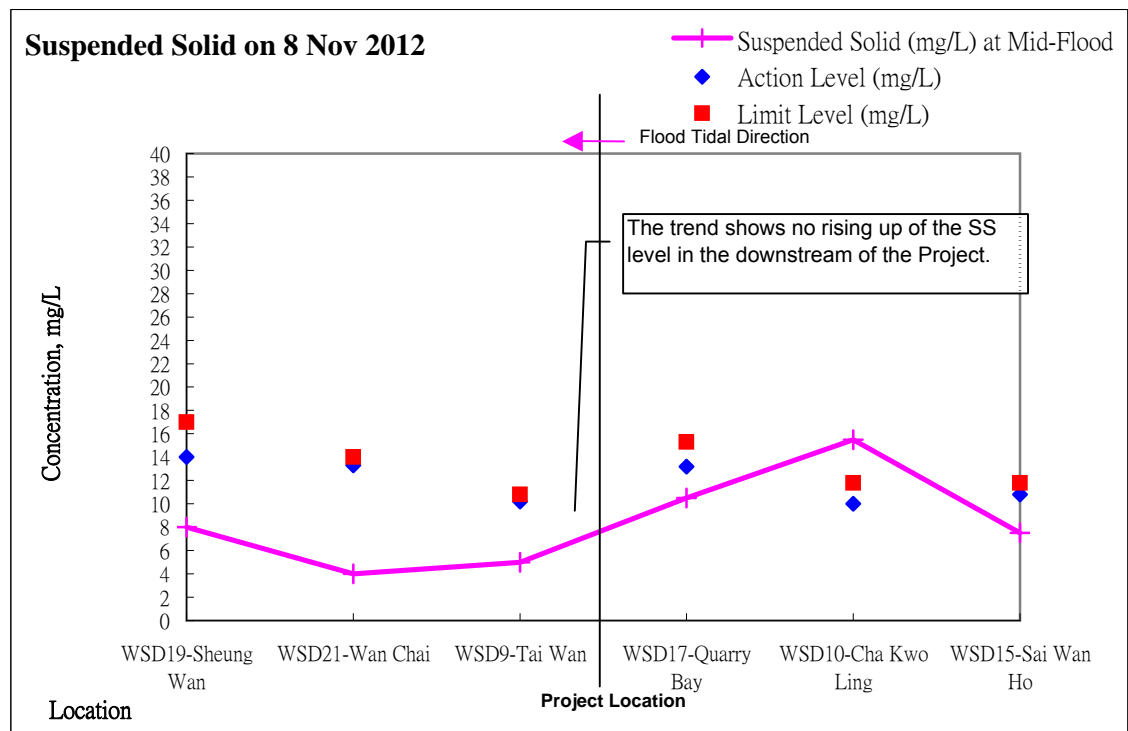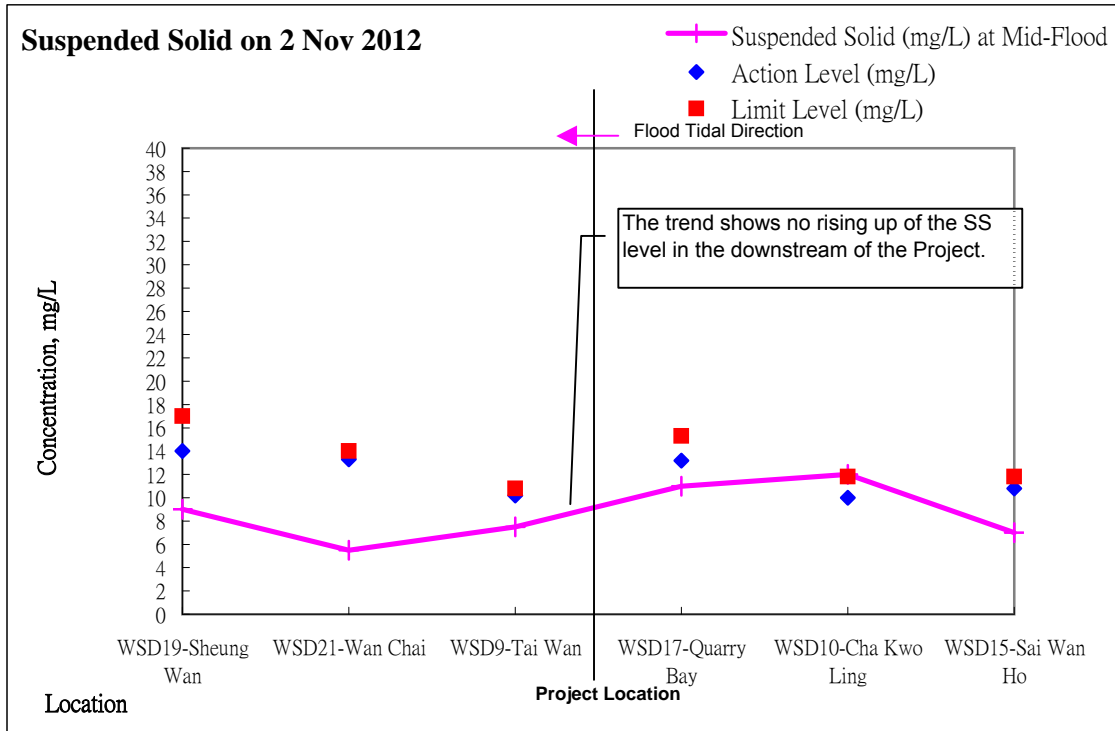



Graphic Presentation of SS Results Against the Tidal Movement along Victoria Harbour

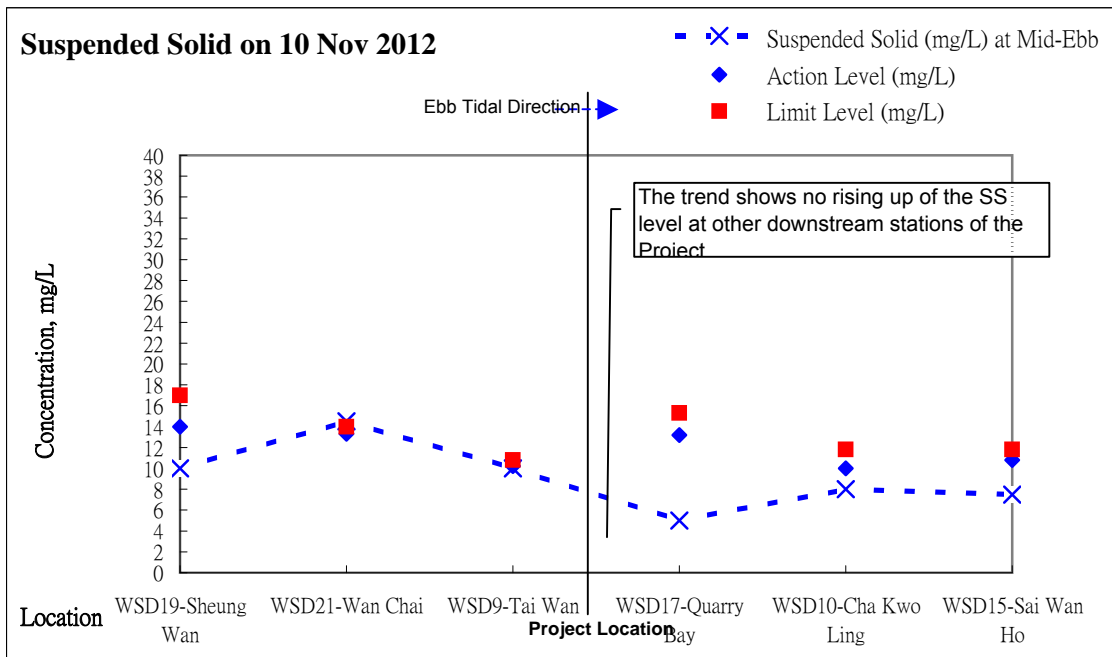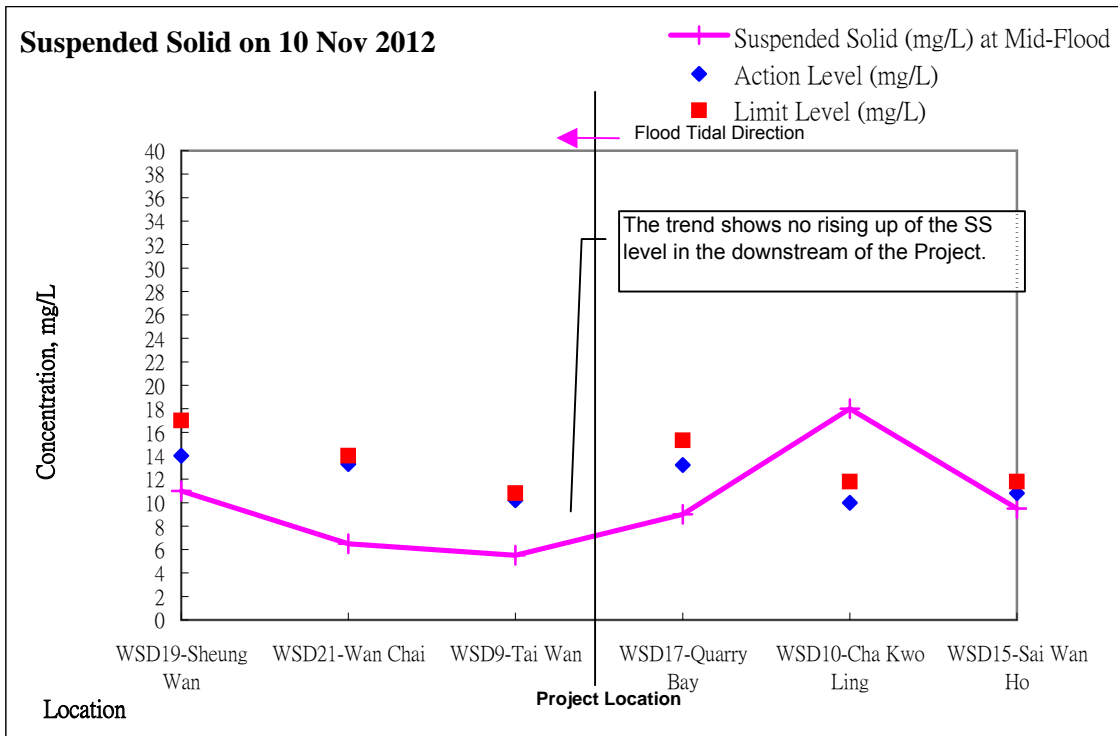

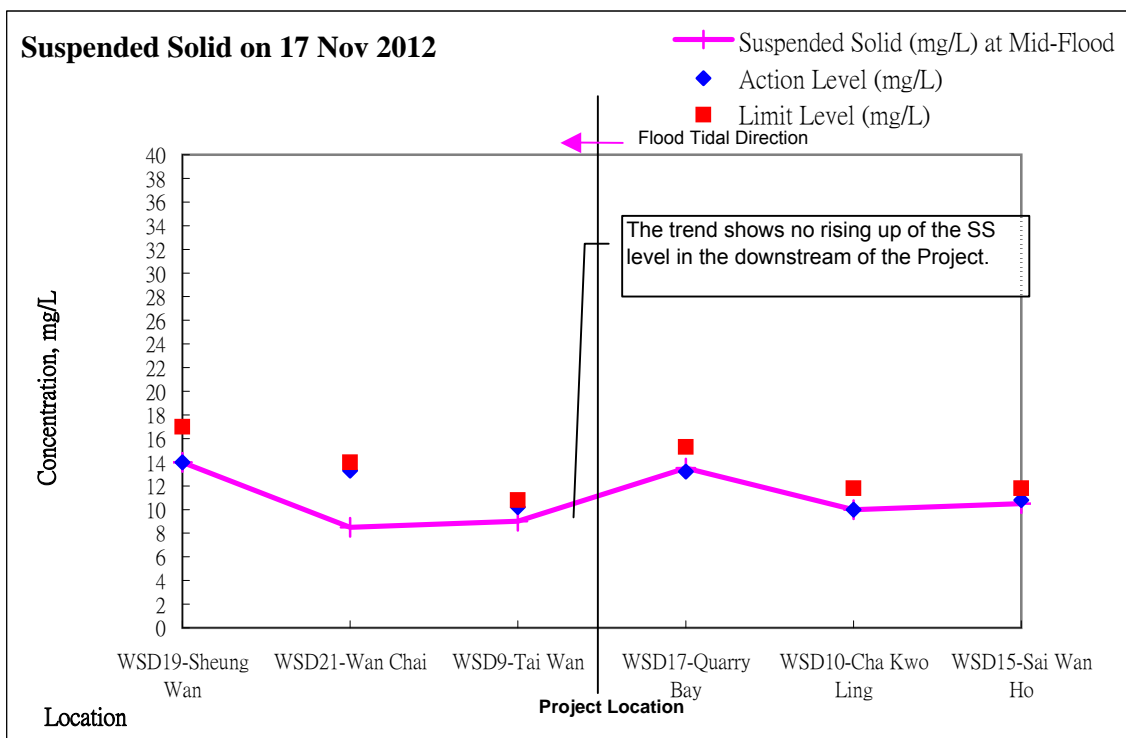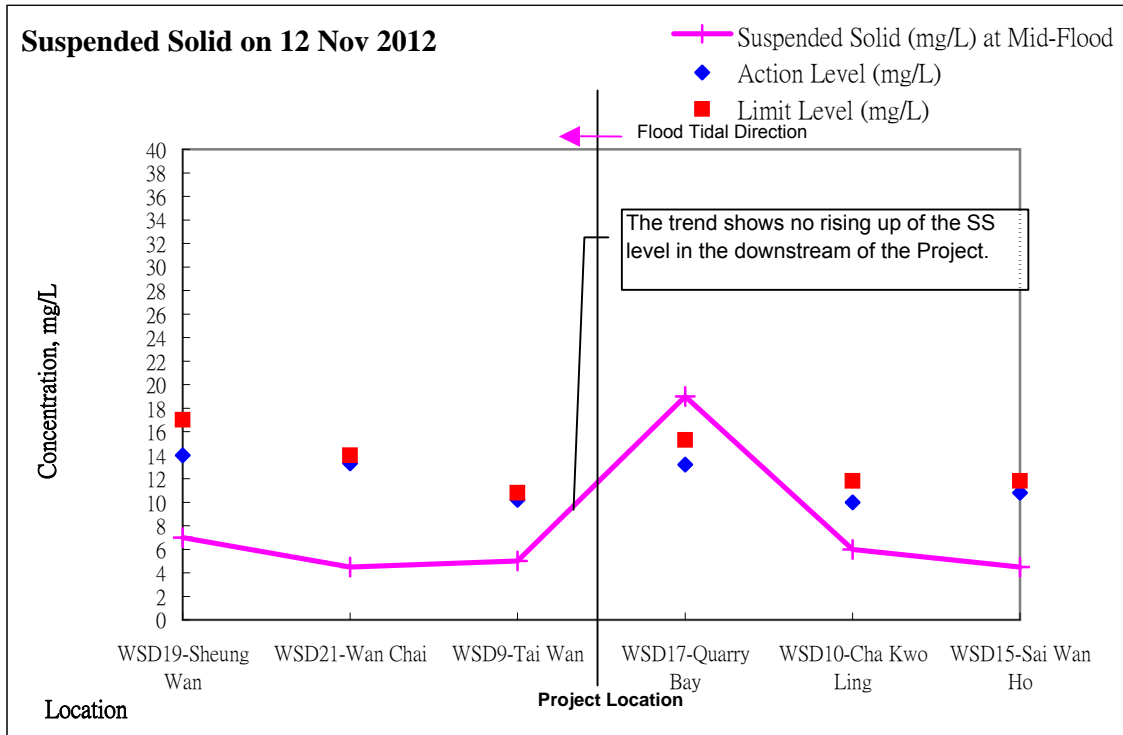




***Appendix 5.3***

***Graphic Presentation of Water Quality Result with respect to Local Variation***






Graphic Presentation of Water Quality Result of WSD9 - Tai Wan with respect to Local Variation

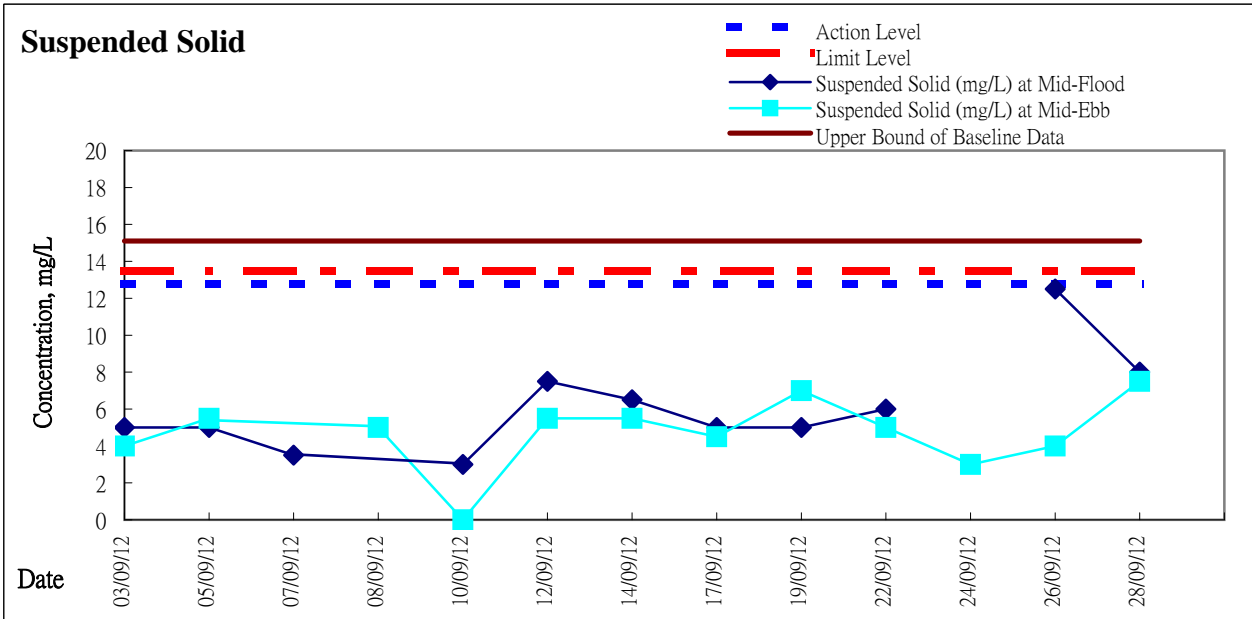

Remarks: WSD9 is located at upstream during the ebb tides while at downstream during flood tides.



Graphic Presentation of Water Quality Result of WSD10 - Cha Kwo Ling with respect to Local Variation

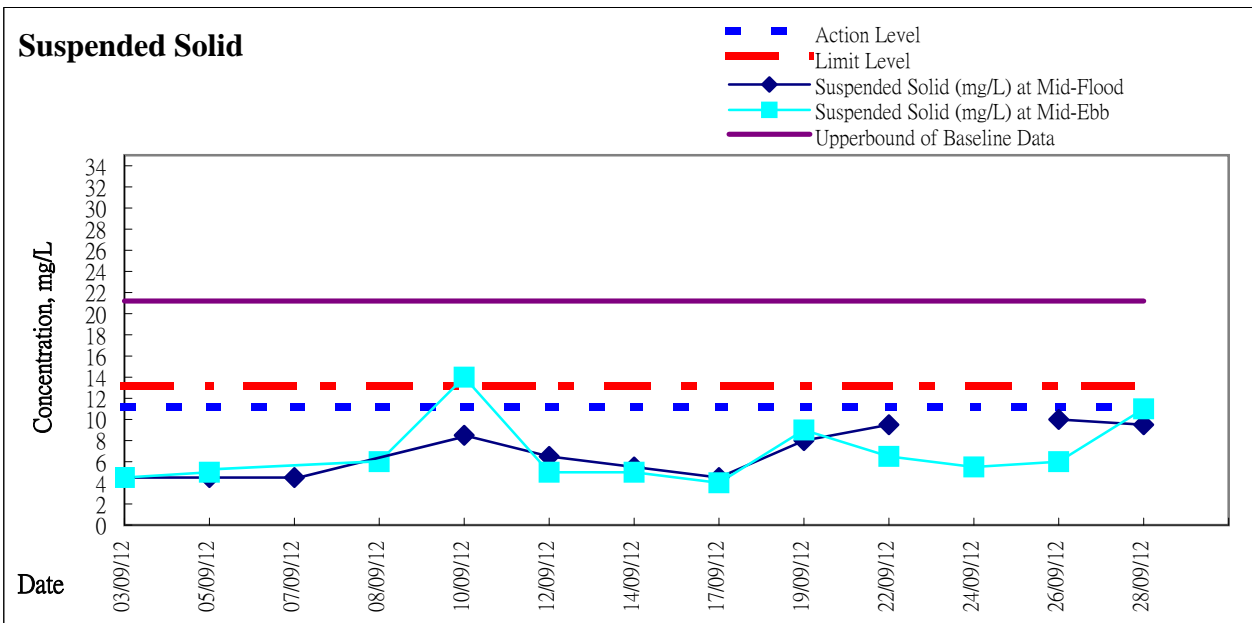


Remarks: WSD10 is located at upstream during the flood tides while at downstream during ebb tides.

Remarks: Due to hoisting of amber rainstorm warning, the water quality monitoring for flood tide on 24 Sep 2012 was cancelled.




Graphic Presentation of Water Quality Result of WSD15 - Sai Wan Ho with respect to Local Variation

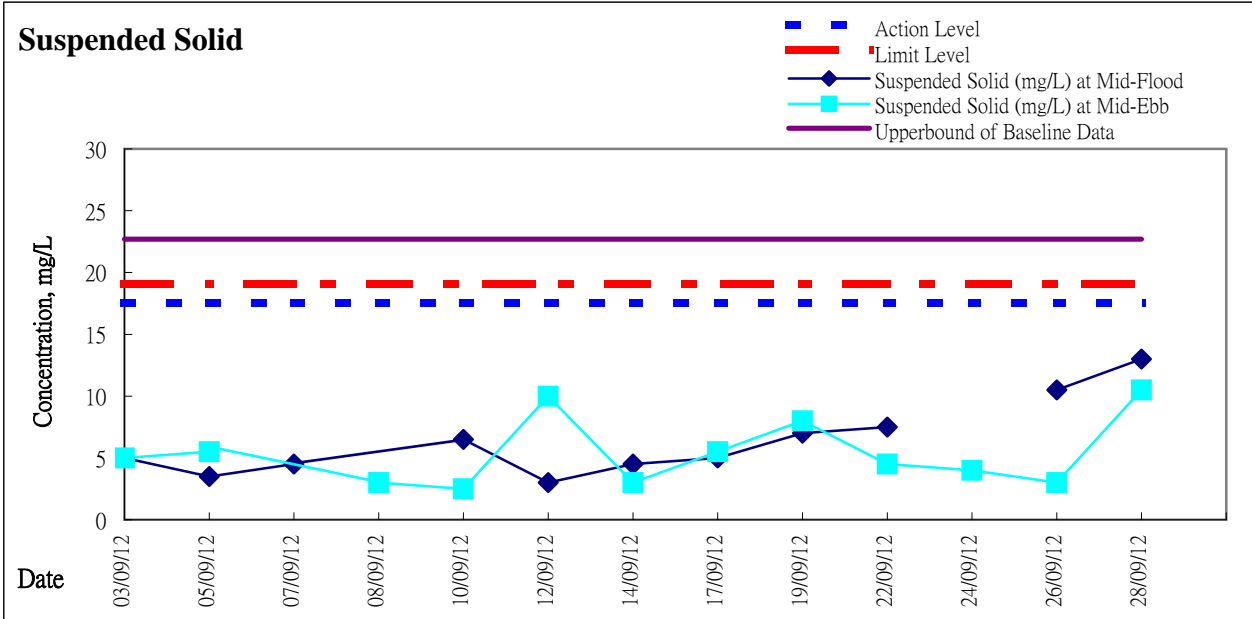

Remarks: WSD15 is located at upstream during the flood tides while at downstream during ebb tides.



Graphic Presentation of Water Quality Result of WSD17 - Quarry Bay with respect to Local Variation

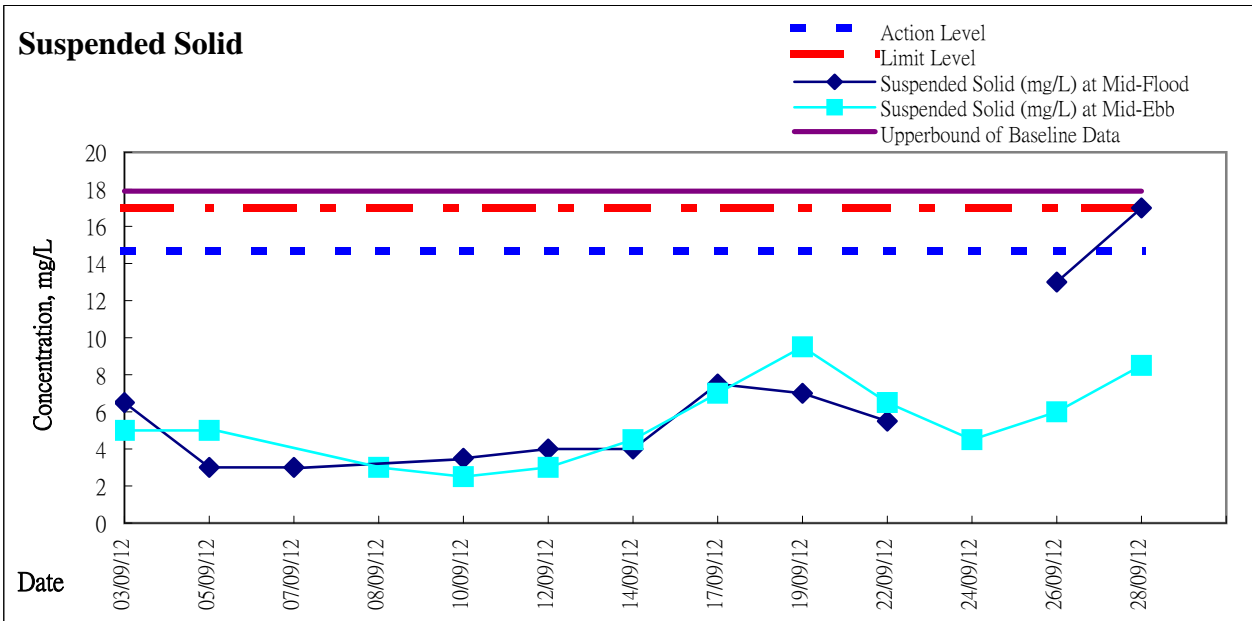


Remarks: WSD17 is located at upstream during the flood tides while at downstream during ebb tides.

Remarks: Due to hoisting of amber rainstorm warning, the water quality monitoring for flood tide on 24 Sep 2012 was cancelled.




Graphic Presentation of Water Quality Result of WSD19 - Sheung Wan with respect to Local Variation

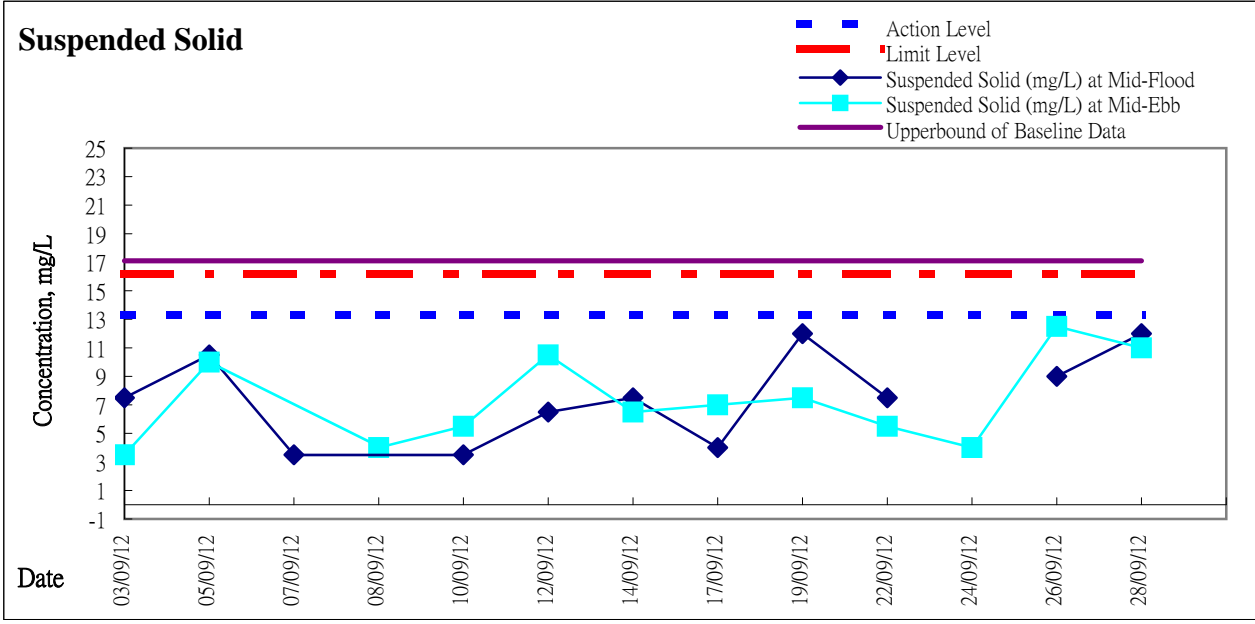

Remarks: WSD19 is located at upstream during the ebb tides while at downstream during flood tides.



Graphic Presentation of Water Quality Result of WSD21 - Wan Chai with respect to Local Variation

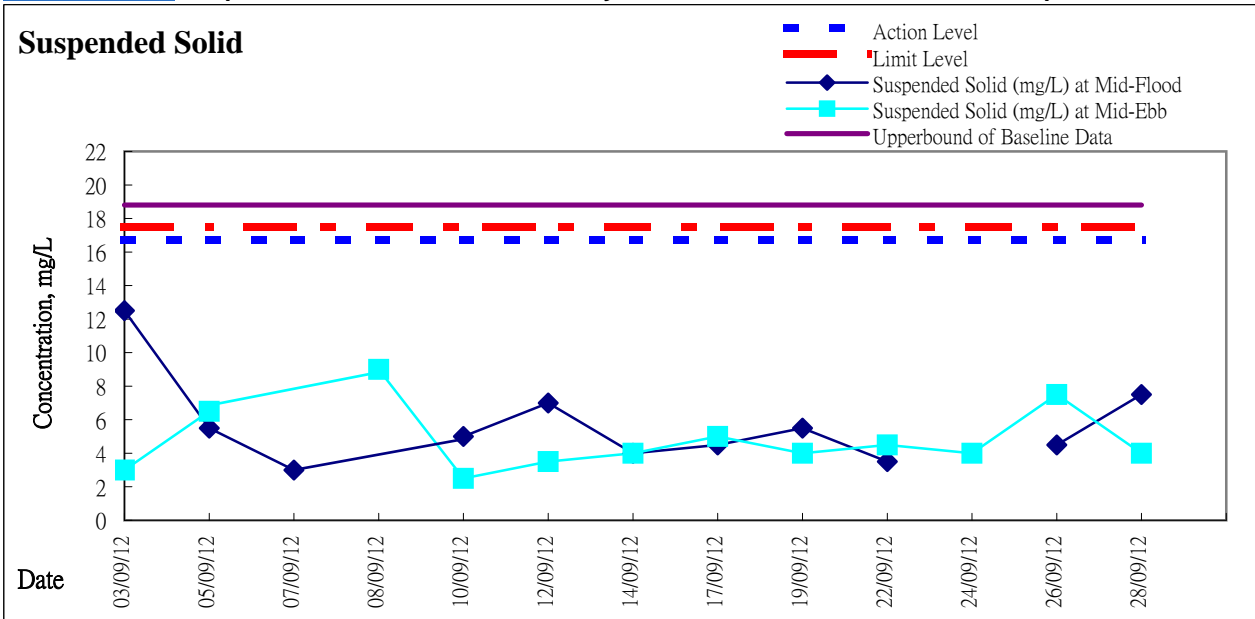


Remarks: WSD21 is located at upstream during the ebb tides while at downstream during flood tides.

Remarks: Due to hoisting of amber rainstorm warning, the water quality monitoring for flood tide on 24 Sep 2012 was cancelled.




Graphic Presentation of Water Quality Result of WSD9 - Tai Wan with respect to Local Variation

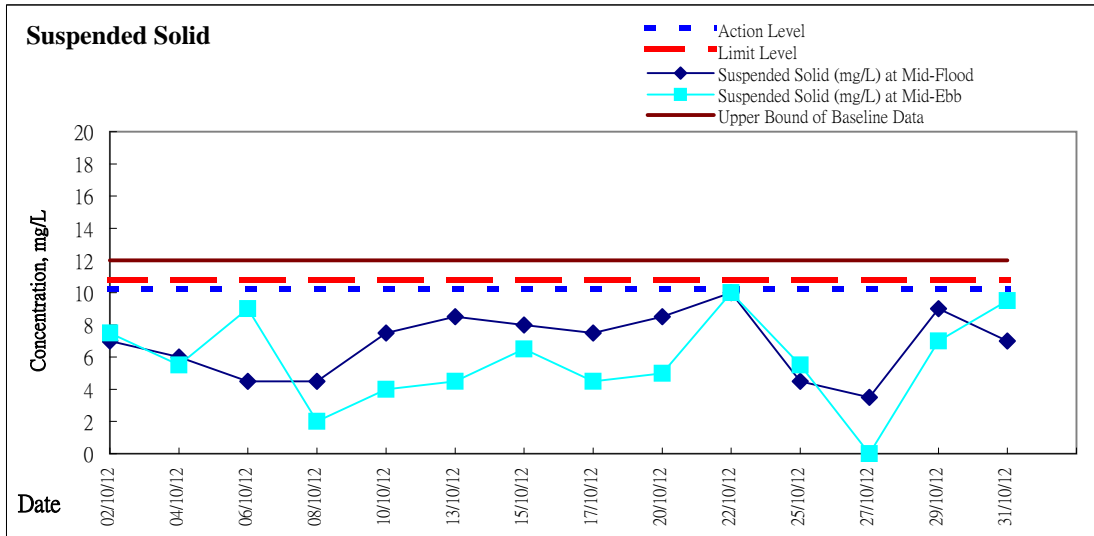

Remarks: WSD9 is located at upstream during the ebb tides while at downstream during flood tides.




Graphic Presentation of Water Quality Result of WSD10 - Cha Kwo Ling with respect to Local Variation

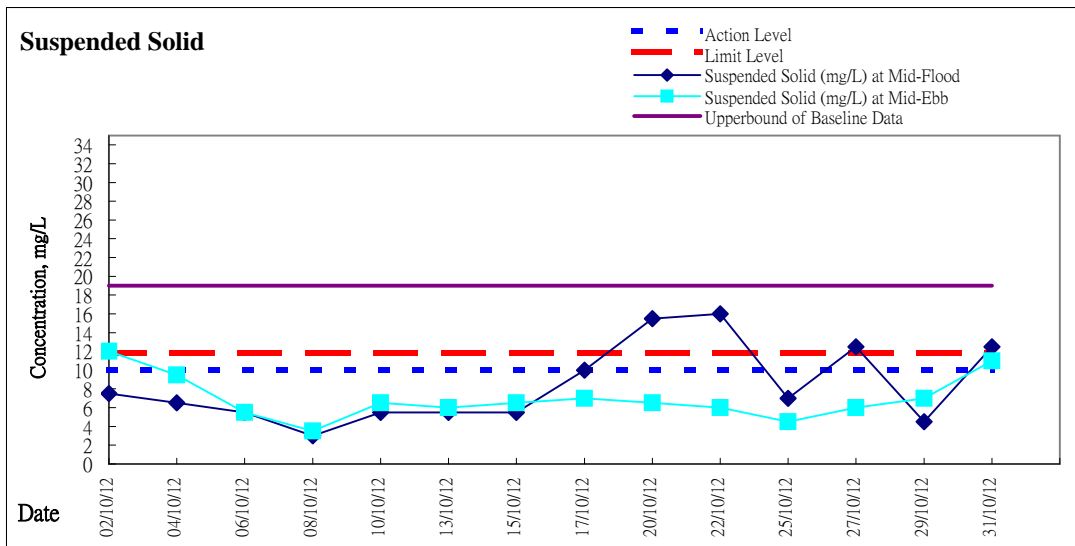


Remarks: WSD10 is located at upstream during the flood tides while at downstream during ebb tides.

Graphic Presentation of Water Quality Result of WSD15 - Sai Wan Ho with respect to Local Variation

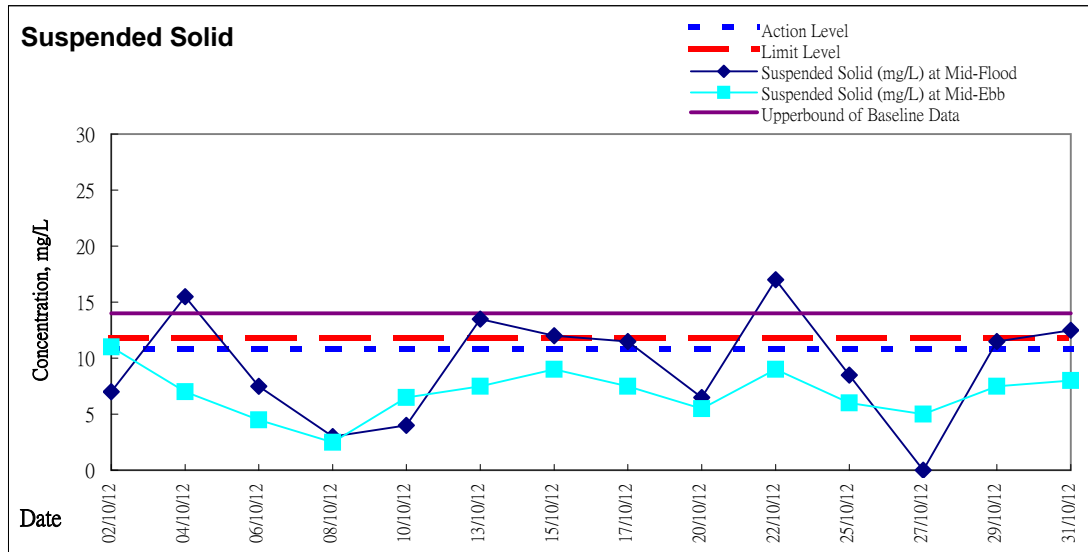

Remarks: WSD15 is located at upstream during the flood tides while at downstream during ebb tides.


Graphic Presentation of Water Quality Result of WSD17 - Quarry Bay with respect to Local Variation

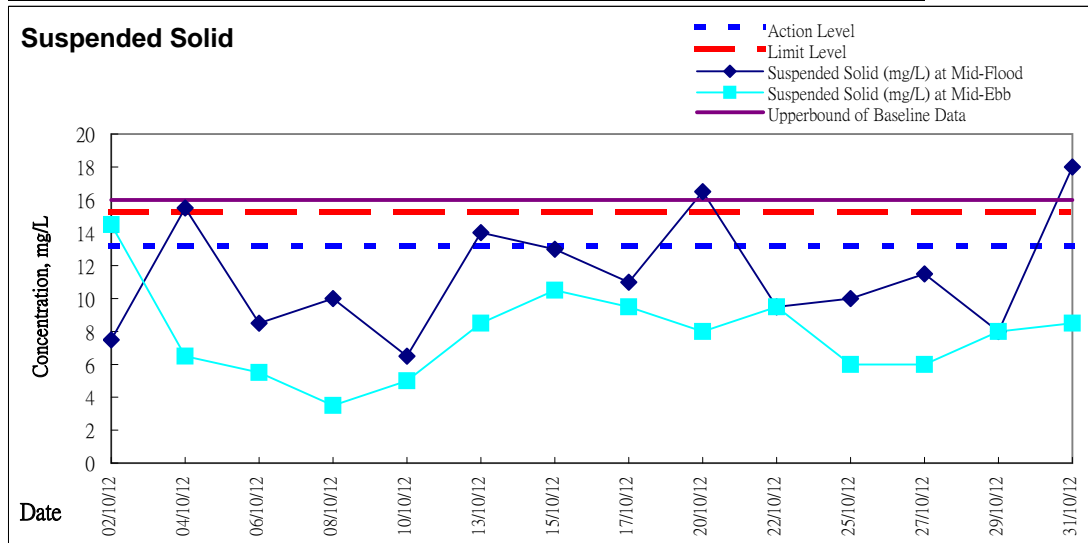

Remarks: WSD17 is located at upstream during the flood tides while at downstream during ebb tides.




Graphic Presentation of Water Quality Result of WSD19 - Sheung Wan with respect to Local Variation

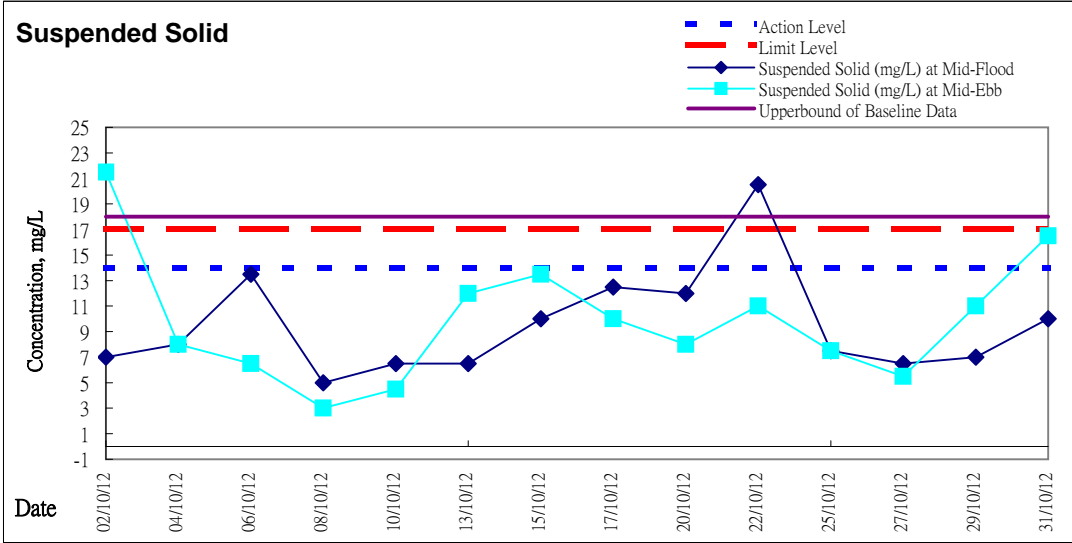

Remarks: WSD19 is located at upstream during the ebb tides while at downstream during flood tides.



Graphic Presentation of Water Quality Result of WSD21 - Wan Chai with respect to Local Variation

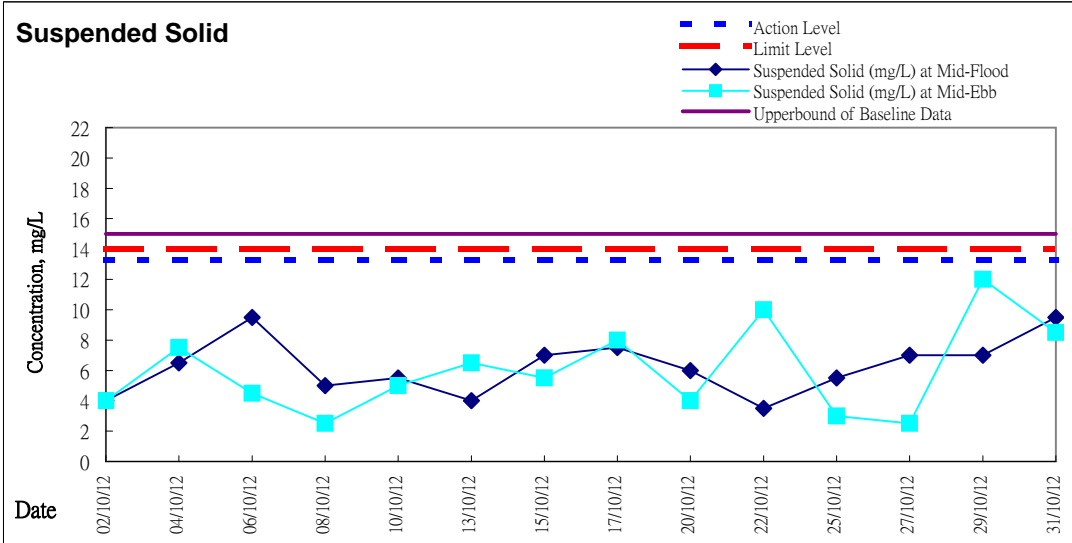


Remarks: WSD21 is located at upstream during the ebb tides while at downstream during flood tides.






Graphic Presentation of Water Quality Result of WSD9 - Tai Wan with respect to Local Variation

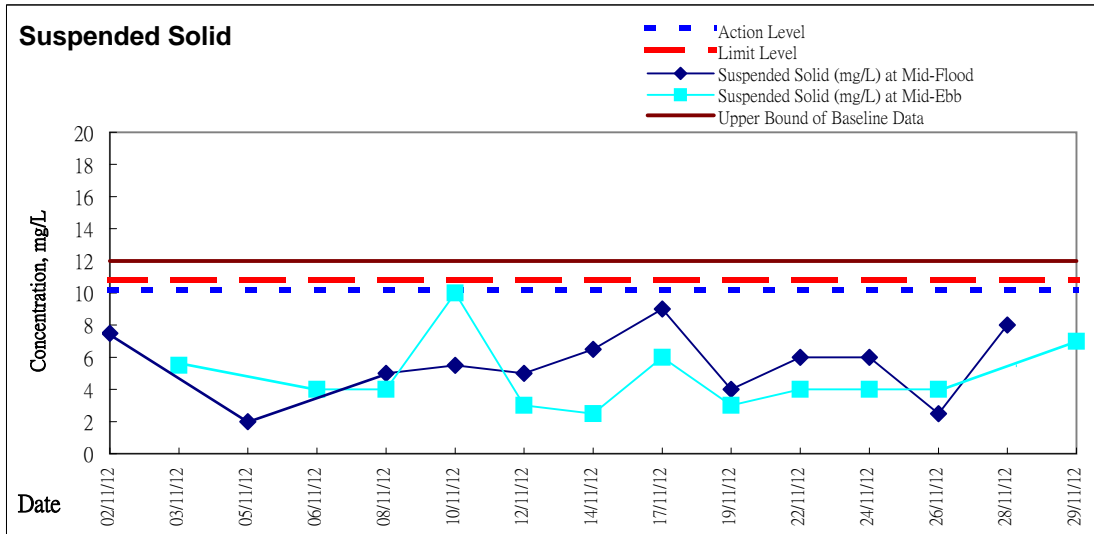

Remarks: WSD9 is located at upstream during the ebb tides while at downstream during flood tides.




Graphic Presentation of Water Quality Result of WSD10 - Cha Kwo Ling with respect to Local Variation

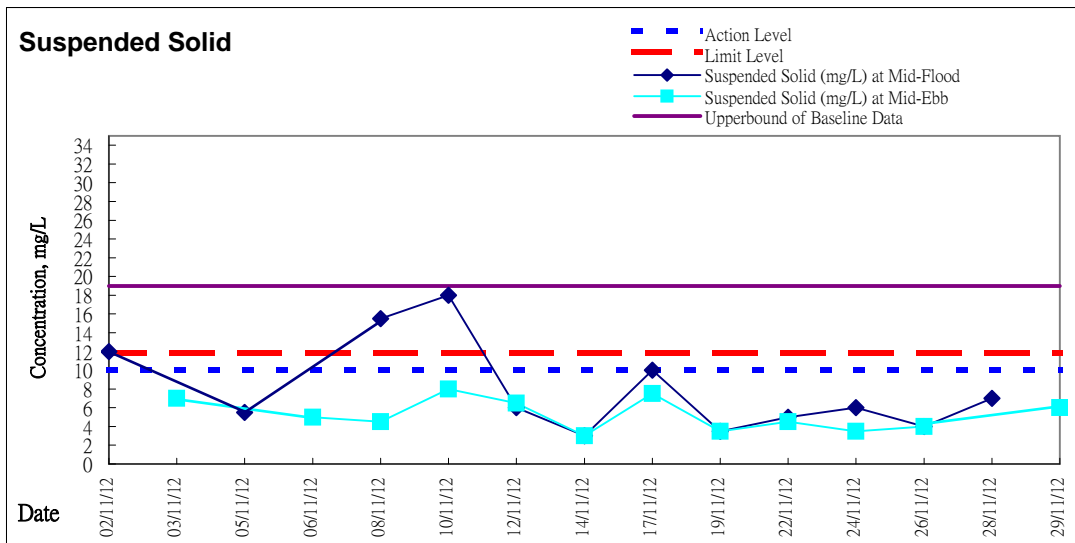

Remarks: WSD10 is located at upstream during the flood tides while at downstream during ebb tides.




Graphic Presentation of Water Quality Result of WSD15 - Sai Wan Ho with respect to Local Variation

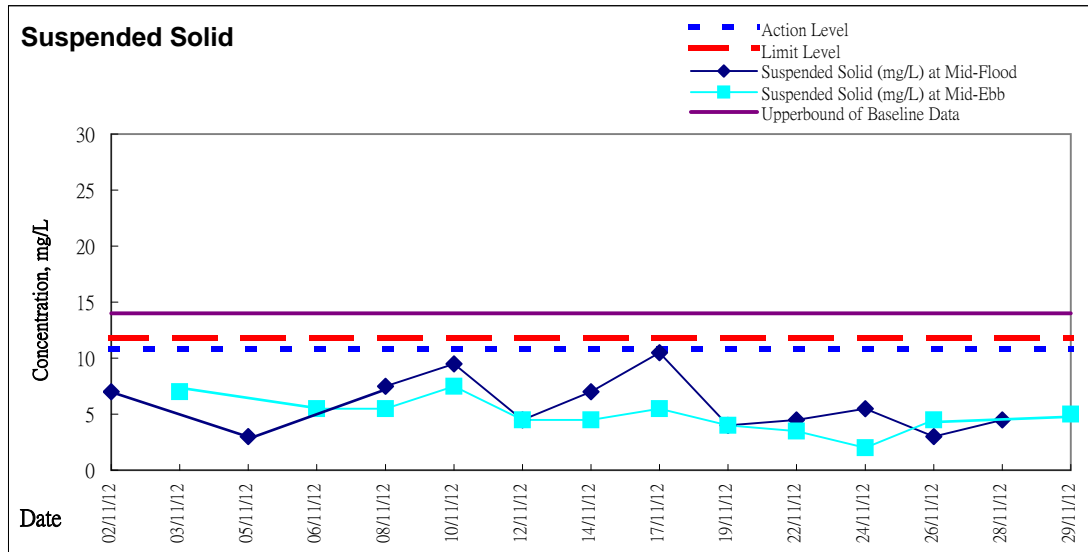

Remarks: WSD15 is located at upstream during the flood tides while at downstream during ebb tides.




Graphic Presentation of Water Quality Result of WSD17 - Quarry Bay with respect to Local Variation

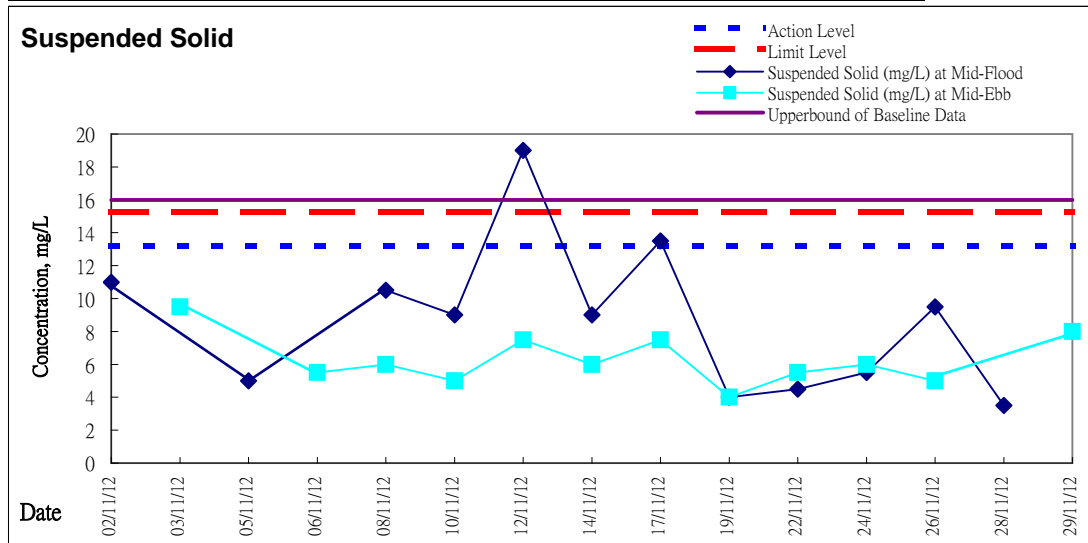

Remarks: WSD17 is located at upstream during the flood tides while at downstream during ebb tides.




Graphic Presentation of Water Quality Result of WSD19 - Sheung Wan with respect to Local Variation

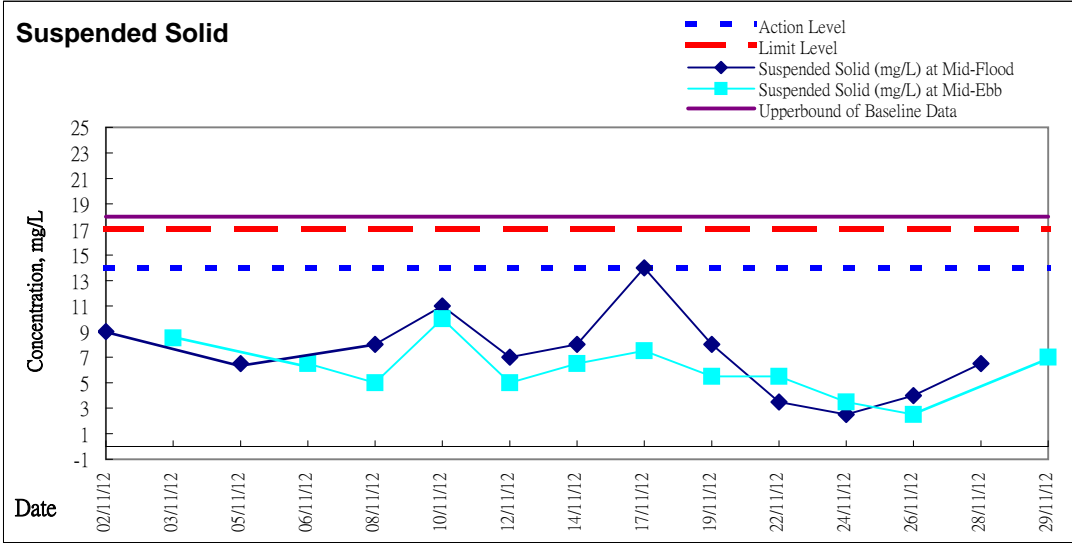

Remarks: WSD19 is located at upstream during the ebb tides while at downstream during flood tides.



Graphic Presentation of Water Quality Result of WSD21 - Wan Chai with respect to Local Variation

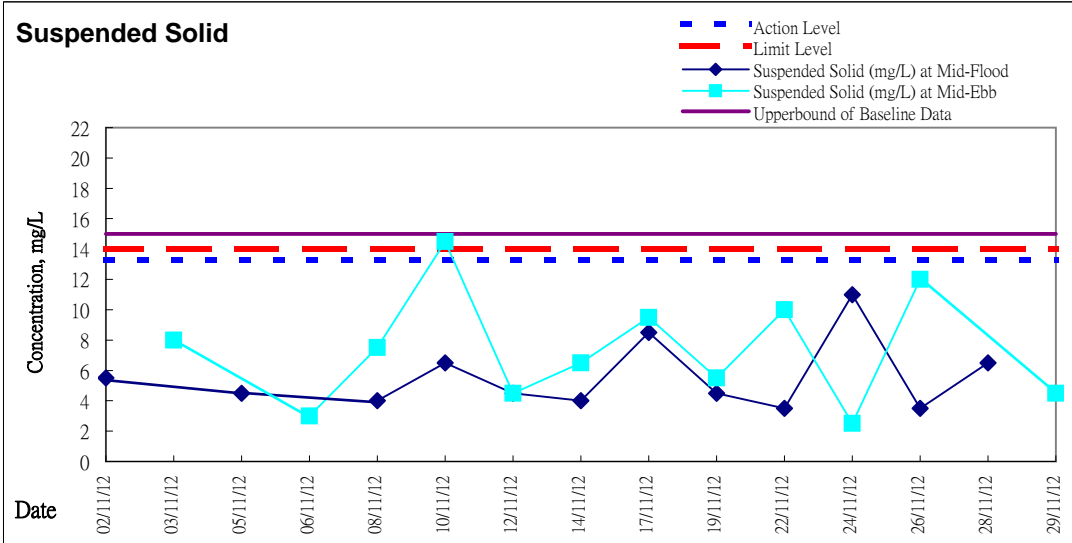

Remarks: WSD21 is located at upstream during the ebb tides while at downstream during flood tides.




***Appendix 7.1***

***Construction Programme for Reporting Quarter***



Activity ID	Activity Description	Orig Dur	Early Start	Late Start	Early Finish	Late Finish	Total Float	% Comp	2012							2013			
									OCT 15	OCT 22	OCT 29	NOV 5	NOV 12	NOV 19	NOV 26	DEC 3	DEC 10	DEC 17	DEC 24
<b>Site Formation KT Cruise Terminal Development</b>																			
<b>Contract Period</b>																			
PD1100	Contract Period	1,495	30/11/09A	30/11/09A	27/12/13	02/01/14	6	71	Contract Period										
<b>Preliminaries &amp; General Requirements</b>																			
<b>Works Interfaces</b>																			
IFW1005	EMSD Installation of Gangway - Phase 1 Berth	242	09/10/12A	09/10/12A	13/05/13	30/05/13*	17	15	EMSD Installation of Gangway - Phase 1 Berth										
<b>Temporary Accommodation</b>																			
TA1060	Servicing of Temp Accommodation for the Engineer	1,406	28/01/10A	28/01/10A	15/12/13	02/01/14	18	70	Servicing of Temp Accommodation for the Engineer										
TA1070	Maintenance of Traffic Flow	1,344	28/02/10A	28/02/10A	23/12/13	02/01/14	10	68	Maintenance of Traffic Flow										
<b>Environmental and Site Safety Monitoring</b>																			
ES1050	Monthly Update of SSP & EMP	1,422	07/12/09A	07/12/09A	20/12/13	02/01/14	13	70	Monthly Update of SSP & EMP										
ES1110	Impact Monitoring for Water Quality	1,380	05/02/10A	05/02/10A	21/12/13	02/01/14	12	69	Impact Monitoring for Water Quality										
ES1125	Maintenance of Silt Screen at WSD Intakes	1,380	31/01/10A	31/01/10A	21/12/13	02/01/14	12	69	Maintenance of Silt Screen at WSD Intakes										
<b>Mobilization &amp; Site Clearance</b>																			
MP1020	Routine Site Cleanliness and Tidiness	1,484	30/11/09A	30/11/09A	23/12/13	02/01/14	10	71	Routine Site Cleanliness and Tidiness										
MP1060	Disposal of Surplus C&D Material	695	10/03/10A	10/03/10A	16/05/13	02/01/14	231	70	Disposal of Surplus C&D Material										
MP1070	Primary Sorting of C&D Material	1,200	26/03/10A	26/03/10A	01/12/13	02/01/14	32	66	Primary Sorting of C&D Material										
MP1080	Surplus Rock Disposal in Area 1 & 2	700	15/02/11A	15/02/11A	04/10/13	02/01/14	90	50	Surplus Rock Disposal in Area 1 & 2										
<b>Sorting of C&amp;D Material</b>																			
SM1110	Bay K - Sorting and Mixing C&D Material	100	17/04/12A	17/04/12A	28/11/12	28/11/12	0	60	Bay K - Sorting and Mixing C&D Material										
SM1120	Bay L - Sorting and Mixing C&D Material	100	04/06/12A	04/06/12A	07/01/13	30/03/13	82	20	Bay L - Sorting and Mixing C&D Material										
SM1130	Bay M - Sorting and Mixing C&D Material	100	06/08/12A	06/08/12A	07/01/13	11/01/13	4	20	Bay M - Sorting and Mixing C&D Material										
SM1140	Bay NDA - Sorting and Mixing C&D Material	100	04/10/12A	04/10/12A	29/01/13	28/04/13	89	5	Bay NDA - Sorting and Mixing C&D Material										
SM1160	PortionDZB-Sorting and Mixing C&D Material(toe)	700	02/04/12A	02/04/12A	08/03/13	02/01/14	300	80	PortionDZB-Sorting and Mixing C&D Material(toe)										
<b>Preparatory Works</b>																			
<b>Production of Precast Units</b>																			
<b>Precast Planks for Decking</b>																			
PW.4.1050	Deliver to Portion MQ4	0	20/10/12	03/01/14			440	0	Deliver to Portion MQ4										
<b>Section 2 - Portions MQ2, LS1, LS2, SDA &amp; DZA</b>																			
<b>Portion LS1</b>																			
<b>Road &amp; Drainage Works</b>																			
SW.23.1090	Street Furniture & Lighting	10	20/10/12	21/11/12	29/10/12	30/11/12*	32	0	Street Furniture & Lighting										
<b>Portion LS2</b>																			
<b>Road &amp; Drainage Works</b>																			
SW.24.1000	600 Dia. Drainage Pipe	42	15/04/11A	15/04/11A	23/10/12	10/12/12	48	90	600 Dia. Drainage Pipe										
SW.24.1060	Base Course	20	06/10/12A	06/10/12A	29/10/12	15/11/12	17	50	Base Course										
SW.24.1070	Wearing Course	15	20/10/12	06/11/12	03/11/12	20/11/12	17	0	Wearing Course										
SW.24.1080	Road Marking	7	30/10/12	16/11/12	05/11/12	22/11/12	17	0	Road Marking										
SW.24.1090	Street Furniture & Lighting	10	04/11/12	21/11/12	13/11/12	30/11/12*	17	0	Street Furniture & Lighting										
<b>Section 3 - Portion MQ3</b>																			
<b>Portion MQ3 (Bays H - I)</b>																			
<b>New Seawall Construction</b>																			
SW.3.4075	Scour Protection Layer (6500m3)	77	24/09/12A	24/09/12A	27/12/12	30/05/13	154	10	Scour Protection Layer (6500m3)										
<b>RC Deck Construction</b>																			
SW.3.5061	Bay H - Site Clearance	4	20/09/12A	20/09/12A	21/10/12	08/05/13	199	50	Bay H - Site Clearance										
SW.3.5070	Bay H - Protective Coating	7	20/08/12A	20/08/12A	22/10/12	09/05/13*	199	80	Bay H - Protective Coating										
SW.3.5140	Bay I - Precast Planks / Fix Rebar	14	20/10/12	25/03/13	02/11/12	07/04/13	156	0	Bay I - Precast Planks / Fix Rebar										
SW.3.5150	Bay I - RC Topping Concreting	7	03/11/12	08/04/13	09/11/12	14/04/13*	156	0	Bay I - RC Topping Concreting										
SW.3.5151	Bay I - Site Clearance	4	24/11/12	29/04/13	27/11/12	02/05/13	156	0	Bay I - Site Clearance										
SW.3.5160	Bay I - Protective Coating	7	28/11/12	03/05/13	04/12/12	09/05/13	156	0	Bay I - Protective Coating										
SW.3.5170	Bay I - Dismantling Working Platform	21	05/12/12	10/05/13	25/12/12	30/05/13	156	0	Bay I - Dismantling Working Platform										

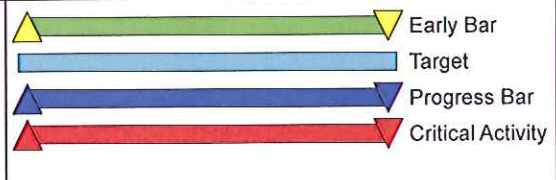

KTAP  
Penta-Ocean Construction Co., Ltd.  
CEDD Contract No. KL/2009/01  
Site Formation for Kai Tak Cruise Terminal Development  
Three Months Rolling Programme (NOVEMBER 2012- JANUARY 2013)

Sheet 1 of 3  
Start Date 30/11/09  
Finish Date 02/01/14  
Data Date 20/10/12  
Run Date 25/10/12 15:58

Date	Revision	Checked	Approved
31/05/11	K	TM	WT
10/10/12	L	TT	KT



Activity ID	Activity Description	Orig Dur	Early Start	Late Start	Early Finish	Late Finish	Total Float	% Comp	2012												2013																												
									OCT			NOV				DEC					JAN		FEB																										
									15	22	29	5	12	19	26	3	10	17	24	31	7	14	21	28	4	11																							
<b>Miscellaneous Work</b>																																																	
SW.3.6020	Installation of Marine Fittings (Fender etc)	28	10/11/12	03/05/13	07/12/12	30/05/13	174	0																																									
SW.3.6030	T&C of Corrosion Monitoring System	21	10/11/12	10/05/13	30/11/12	30/05/13	181	0																																									
SW.3.6040	Installation of Navigation Light Post	28	10/11/12	03/05/13	07/12/12	30/05/13	174	0																																									
SW.3.6050	Flexible Surfacing	28	10/11/12	26/04/13	07/12/12	23/05/13	167	0																																									
SW.3.6060	Road Marking	7	08/12/12	24/05/13	14/12/12	30/05/13	167	0																																									
<b>Section 4 - Portions MQ4, LS3, NDA &amp; DZB</b>																																																	
<b>Portion MQ4 (Bays J - M) &amp; LS3</b>																																																	
<b>Dredging Work &amp; Removal of Existing Seawall</b>																																																	
SW.4.3030	Bay K - Excavation Within MQ4 (22000m3)	35	13/06/12A	13/06/12A	30/10/12	30/10/12	0	70																																									
SW.4.3045	Bay L - Existing Seawall Rockfill (16500m3)	35	19/06/12A	19/06/12A	02/11/12	05/01/13	64	60																																									
SW.4.3050	Bay L - Excavation Within MQ4 (22000m3)	35	18/07/12A	18/07/12A	23/11/12	26/01/13	64	40																																									
SW.4.3065	Bay M - Existing Seawall Rockfill (20000m3)	35	10/07/12A	10/07/12A	02/11/12	02/11/12	0	60																																									
SW.4.3070	Bay M - Excavation Within MQ2 (25000m3)	35	18/07/12A	18/07/12A	06/11/12	06/11/12*	0	50																																									
<b>New Seawall Construction</b>																																																	
SW.4.4020	Bay K - Filter 1 (2000m3)	11	16/09/12A	16/09/12A	05/11/12	05/11/12	0	50																																									
SW.4.4025	Bay K - Filter 2 (2000m3)	10	17/09/12A	17/09/12A	10/11/12	10/11/12	0	50																																									
SW.4.4030	Bay K - Secondary Armour 0.16T ~ 0.25T (2500m3)	14	19/09/12A	19/09/12A	18/11/12	18/11/12	0	40																																									
SW.4.4035	Bay K - Primary Armour 2.3T (1500m3)	15	14/11/12	14/11/12	28/11/12	28/11/12*	0	0																																									
SW.4.4040	Bay L - Filter 1 (2000m3)	11	24/11/12	27/01/13	04/12/12	06/02/13	64	0																																									
SW.4.4045	Bay L - Filter 2 (2000m3)	10	05/12/12	07/02/13	14/12/12	16/02/13	64	0																																									
SW.4.4050	Bay L - Secondary Armour 0.16T ~ 0.25T (2500m3)	21	15/12/12	17/02/13	04/01/13	09/03/13	64	0																																									
SW.4.4055	Bay L - Primary Armour 2.3T (1500m3)	21	05/01/13	10/03/13	25/01/13	30/03/13	64	0																																									
SW.4.4060	Bay M - Filter 1 (2150m3)	11	07/11/12	14/11/12	17/11/12	24/11/12	7	0																																									
SW.4.4065	Bay M - Filter 2 (2150m3)	10	18/11/12	25/11/12	27/11/12	04/12/12	7	0																																									
SW.4.4070	Bay M - Secondary Armour 0.16T ~ 0.25T (3000m3)	14	23/11/12	30/11/12	06/12/12	13/12/12	7	0																																									
SW.4.4075	Bay M - Primary Armour 2.3T (1650m3)	14	05/12/12	09/12/12	18/12/12	22/12/12*	4	0																																									
<b>RC Deck Construction</b>																																																	
SW.4.5005	Bay J (S) - Formwork	30	15/09/12A	15/09/12A	31/10/12	05/11/12	5	60																																									
SW.4.5010	Bay J (S) - Rebar Fixing	15	01/10/12A	01/10/12A	27/10/12	10/11/12	14	80																																									
SW.4.5015	Bay J - Corrosion Monitoring System	7	06/11/12	11/11/12	12/11/12	17/11/12	5	0																																									
SW.4.5020	Bay J (S) - Deck Beam Concreting	35	13/11/12	18/11/12*	17/12/12	22/12/12	5	0																																									
SW.4.5021	Bay J (N) - Formwork	30	15/09/12A	15/09/12A	31/10/12	05/11/12	5	60																																									
SW.4.5022	Bay J (N) - Rebar Fixing	15	22/10/12	27/10/12	05/11/12	10/11/12	5	0																																									
SW.4.5023	Bay J (N) - Deck Beam Concreting	35	13/11/12	18/11/12*	17/12/12	22/12/12	5	0																																									
SW.4.5025	Bay J - Precast Planks/Fix Rebar	14	18/12/12	10/09/13	31/12/12	23/09/13	266	0																																									
SW.4.5030	Bay J - RC Topping Concreting	7	01/01/13	24/09/13	07/01/13	30/09/13*	266	0																																									
SW.4.5031	Bay J - Site Clearance	4	22/01/13	09/12/13	25/01/13	12/12/13	321	0																																									
SW.4.5035	Bay J - Protective Coating	7	26/01/13	13/12/13	01/02/13	19/12/13	321	0																																									
SW.4.5040	Bay J - Dismantling Working Platform	14	02/02/13	20/12/13	15/02/13	02/01/14	321	0																																									
SW.4.5045	Bay K - Erection of Suspension Working Platform	20	17/01/13	14/02/13	05/02/13	05/03/13	28	0																																									
SW.4.5050	Bay K - Formwork	30	27/01/13	24/02/13	25/02/13	25/03/13	28	0																																									
SW.4.5135	Bay M - Erection of Suspension Working Platform	20	23/01/13	13/03/13	11/02/13	01/04/13	49	0																																									
<b>Miscellaneous Work</b>																																																	
SW.4.6010	Bay J - Utilities Trough/Sewerage Inside Deck	35	18/12/12	29/11/13	21/01/13	02/01/14	346	0																																									
<b>Portion NDA (Bay NDA)</b>																																																	
<b>Precast Front Panel (PFP) &amp; Temp. Piling Bracing</b>																																																	
SW.41.2040	Installation of Temp. Bracing & Supporting	21	20/09/12A	20/09/12A	23/10/12	30/12/12	68	80																																									
<b>Dredging Work &amp; Removal of Existing Seawall</b>																																																	
SW.41.2900	Install Silt Curtain System (Bay NDA)	7	20/10/12	10/12/12	26/10/12	16/12/12	51	0																																									
SW.41.3000	Removal of Existing Seawall Armour (4500m3)	21	27/10/12	17/12/12	16/11/12	06/01/13	51	0																																									
SW.41.3010	Removal of Existing Seawall Rockfill (16500m3)	35	10/11/12	31/12/12	14/12/12	03/02/13	51	0																																									
SW.41.3020	Excavation Within MQ4 (22000m3)	35	01/12/12	21/01/13	04/01/13	24/02/13	51	0																																									

