

Construction of a Secondary Boundary Fence and
New Sections of Primary Boundary Fence and
Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha
Tau Kok, Planting Works at Tak Yuet Lau and
Demolition Work at Shek Chung Au, Lo Wu to Sha
Tau Kok – Monthly EM&A Report for June 2016

July 2016

Architectural Services Department



Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok,
Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung
Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016

July 2016

Architectural Services Department

39/F Queensway Government Offices, 66 Queensway, Hong Kong

**Pursuant to Condition 4.5 of Environmental Permit No. EP-347/2009/A,
this Monthly EM&A Report for June 2016 has been certified by the
Environmental Team Leader and verified by the Independent
Environmental Checker as having complied with the requirements as set
out in the EM&A Manual.**

Certified by:



Brandon Wong
Environmental Team Leader (ETL)
Mott MacDonald Hong Kong Limited

Date:

8 July 2016

Verified by:



David Yeung
Independent Environmental Checker (IEC)
Ramboll Environ Hong Kong Limited

Date:

12 July 2016

Content

Chapter	Title	Page
	Executive Summary	i
1.	Introduction	1
1.1	Background	1
1.2	Project Organisation	3
1.3	Works Undertaken in the Reporting Month	3
2.	EM&A Requirements	5
2.1	Summary of EM&A Requirements	5
2.2	Implementation of Environmental Mitigation Measures	5
3.	Noise Impact Monitoring	6
3.1	Monitoring Parameters, Frequency and Duration	6
3.2	Monitoring Location	6
3.3	Monitoring Equipment	7
3.4	Equipment Calibration	8
3.5	Monitoring Methodology	8
3.5.1	Field Monitoring	8
3.5.2	Maintenance and Calibration	8
3.6	Results of Impact Monitoring	9
3.7	Exceedance Investigation and Findings	9
4.	Environmental Site Inspection and Audit	10
4.1	Site Inspections	10
4.2	Environmental Meetings	11
4.3	Status of Environmental Submissions, Permits and Licences	11
4.4	Advice on the Solid and Liquid Waste Management Status	12
4.5	Review of Environmental Monitoring Procedures	12
4.6	Implementation Status of Environmental Mitigation Measures	12
5.	Record of Non-compliance, Complaints, Notifications of Summons and Successful Prosecutions	13
5.1	Non-compliance of Action and Limit Levels	13
5.2	Environmental Complaints	13
5.3	Notifications of Summons and Successful Prosecutions	13
5.4	Review of Reasons for and Implication of Non-compliance, Complaints, Summons and Prosecutions	13
5.5	Follow-up Actions Taken	13
6.	Future Key Issues	14
6.1	Construction Programme for the Next Reporting Month	14
6.2	Key Issues for the Next Reporting Month	14
6.3	Monitoring Schedule for the Next Reporting Month	15

7.	Conclusions and Recommendations	16
7.1	Conclusions _____	16
7.2	Recommendations _____	16

Appendices	17
Appendix A. Construction Works Programme _____	18
Appendix B. Project Organisation Chart _____	19
Appendix C. Environmental Quality Performance Limits _____	20
Appendix D. Event and Action Plans _____	21
Appendix E. Schedule of Mitigation Measures from the EIA Report and EM&A Manual _____	22
Appendix F. EM&A Schedule _____	33
Appendix G. Calibration Certificates _____	35
Appendix H. Noise Monitoring Results and Graphical Presentation _____	36
Appendix I. Monthly Waste Flow Table _____	37
Appendix J. Complaint Log _____	38
Appendix K. Weather Information from Hong Kong Observatory _____	39

Figures

Figure 1.1: General Layout Plan	
Figure 2.1: Location of Noise Monitoring Stations	
Figure 2.2: Location of Noise Monitoring Station for Demolition of Shek Chung Au Check Point	
Figure 2.3: Location of Noise Monitoring Station for Demolition for Existing Fence	

Tables

Table 2.1: Summary of EM&A Impact Requirements _____	5
Table 3.1: Noise Monitoring Parameters, Frequency and Duration _____	6
Table 3.2: Noise Impact Monitoring Location _____	7
Table 3.3: Noise Monitoring Equipment _____	8
Table 3.4: Noise Monitoring Equipment Calibration Frequencies _____	8
Table 3.5: Result of Noise Impact Monitoring _____	9
Table 4.1: Summary of Environmental Site Inspections _____	10
Table 4.2: Status of Environmental Permits and Licences _____	11
Table 4.3: Implementation Schedule of Mitigation Measures _____	12
Table C.1: Action and Limit Levels for Construction Noise _____	20
Table D.1: Event and Action Plan for Construction Noise _____	21
Table E.1: Recommended Mitigation Measures – Air Quality _____	22
Table E.2: Recommended Mitigation Measures – Noise _____	23
Table E.3: Recommended Mitigation Measures – Water Quality _____	24
Table E.4: Recommended Mitigation Measures – Waste Management _____	26
Table E.5: Recommended Mitigation Measures – Ecology _____	28
Table E.6: Recommended Mitigation Measures – Landscape and Visual _____	29
Table I.1: Monthly Summary Waste Flow Table for 2016 (from April) _____	37
Table J.1: Complaint Log for the Reporting Month _____	38

Executive Summary

Mott MacDonald Hong Kong Limited (MMHK) has been commissioned by the Architectural Services Department (ArchSD) as the Environmental Team (ET) to carry out Environmental Monitoring and Audit (EM&A) services for improvement works along the boundary in the Frontier Closed Area (FCA), planting works at Tak Yuet Lau, the demolition works at Shek Chung Au and the minor work order “Demolition of Existing Security Facilities from Lo Wu to Sha Tau Kok” (the subject works), which form part of the “Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road” (the Project).

This Monthly EM&A Report covers the works carried out during the reporting month from 1 to 30 June 2016 and presents a summary of the environmental monitoring and audit works, list of activities, and mitigation measures implemented during the same period.

Site Activities

The following major construction activities took place during the reporting month:

Improvement Works for Boundary Fence at Mai Po, Lok Ma Chau and Sha Tau Kok:

All improvement works have been completed. ArchSD issued a letter on 8 December 2015 certifying that the improvement works (Works Order No. ASD011777) were substantially completed on 13 November 2015. Minor works for defects rectification were completed in the week ending 12 December 2015.

Landscaping Works at Tak Yuet Lau:

- Maintenance of trees and shrubs

Demolition Works at Shek Chung Au:

- Nil*.

*Note: The remaining works at Shek Chung Au, namely removal of vehicle inspection shelter, were omitted from the relevant works order (No. ASD 011783) by ER’s instruction on 1 March 2016. On the same day, ArchSD certified that Works Order No. ASD011783 was substantially completed on 3 February 2016. A proposal to suspend the EM&A programme at Shek Chung Au was prepared by ET on 7 March 2016, verified by IEC on 9 March 2016 and submitted to EPD on 10 March 2016. The EM&A programme at Shek Chung Au was suspended on 23 June 2016.

Demolition Works from Lo Wu to Sha Tau Kok:

- Demolition of Police Post and Inspection Shelter in Ping Che.

Breach of Action and Limit Levels

There was no breach of Action or Limit levels for noise impact monitoring in the reporting month.

Complaints

There was no record of complaints received in the reporting month.

Notification of Summons and Successful Prosecutions

There was no record of notification of summons and successful prosecution in the reporting month.

Reporting Changes

There are no reporting changes in the reporting month.

Future Key Issues

Future key issues to be considered in the forthcoming month include:

Air

- Regular maintenance of all plant and equipment;
- Handling of any excavated dusty materials or stockpile of dusty material; and
- Spraying of water prior to any loading, unloading or transfer of dusty materials.

Noise

- Location of noisy equipment and noisy activities relative to the Noise Sensitive Receivers (NSRs);
- Avoiding the operation of unused equipment, and minimising the use of Powered Mechanical Equipment (PME) and parallel use of noisy equipment / machinery; and
- Regular maintenance of all plant and equipment.

Water Quality

- No discharge of silty water into the storm drain and drainage channel within and the vicinity of the site;
- Removal off-site of construction plant causing pollution to water system due to leakage of oil or fuel; and
- Temporary stockpiling of excavated soil in a specially designated area with provision of tarpaulin cover.

Waste

- Control measures at the stockpiling area to prevent the generation of dust and pollution of stormwater channels, fish ponds or river channels;
- Segregation, storage, transportation and disposal of different types of waste; and
- Keeping of records of quantities of wastes generated, recycled and disposal (with locations).

Ecology

- Good site practices for controlling the dust and water quality; and
- Clear definition of works limit to avoid impact on adjacent habitats.

Landscape and Visual

- Retain tree with high amenity or ecology value and contributing most to landscape and amenity of site;
- Precautionary area around trees to be retained equal to half of the tree canopy diameter;

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



- Prohibition of the storage of materials including fuel, the movement of construction vehicles, and the refuelling and washing of equipment including concrete mixers within the precautionary area;
- Pruning of the branches of existing trees identified for transplantation and retention;
- Rectification and repair of damaged vegetation following the construction phase to its original condition;
- Careful monitoring of all works affecting the trees identified for retention and transplantation; and
- Enforcement of construction site controls including storage of materials, location and appearance of site accommodation and the careful design of site lighting to prevent light spillage.

Environmental mitigation measures will be implemented on site as recommended and weekly site audits will be carried out to ensure that the environmental conditions are acceptable.

1. Introduction

1.1 Background

The Frontier Closed Area (FCA) is an integral part of the package of measures aimed at maintaining the integrity of the boundary of the Hong Kong Special Administrative Region (HKSAR) with mainland China, and combating illegal immigration and other cross-boundary criminal activities. Following a recent review, the HKSAR Government has concluded that with the erection of a secondary boundary fence (SBF) along the boundary patrol road (BPR) and construction of new sections of the BPR and primary boundary fence (PBF) at certain sections along the boundary, the FCA coverage can be substantially reduced without affecting the objective of maintaining the integrity of the boundary.

The erection of the PBF and SBF (hereafter referred to as 'The Project') along the northern and southern curbs of the realigned BPR respectively aims to facilitate the Hong Kong Police Force (HKPF) in combating cross-boundary criminal activities. The reduced FCA will comprise a narrow strip of land covering the realigned BPR and areas to its north, together with the points of crossing the boundary (i.e. the Boundary Control Points and Sha Tau Kok town). Areas south of the SBF will generally be excised from the FCA.

An Environmental Impact Assessment (EIA) for the proposed works was carried out under the Environmental Impact Assessment Ordinance (EIAO, Cap 499). An EIA Report and an Environmental Monitoring and Audit (EM&A) Manual were completed in January 2009 and approved by the Environmental Protection Department (EPD) in April 2009 (Register No. AEIAR-136/2009). The entire length of the proposed works is about 21.7 km from west of Pak Hok Chau to east of Sha Tau Kok and is divided into four sections. A general layout plan of the Project site is presented in **Figure 1.1**, in which Section 3 is further divided into 3 sub-sections: Section 3A, 3B and 3C. The construction of the project will be implemented in two phases – Phase 1 and Phase 2. Phase 1 covers Section 1, 2 and 4; Phase 2 covers Sections 3A and 3C.

An Environmental Permit (EP) covering the overall proposed works was issued in June 2009 (Permit No. EP-347/2009). An application for Variation of the Environmental Permit (VEP) (Application No. VEP-314/2010) was subsequently submitted on 24 May 2010 and the amended Environmental Permit (Permit No. EP-347/2009/A) was issued by EPD on 9 June 2010.

The Architectural Services Department (ArchSD) has been entrusted with the management of the Project by the Project Proponent – the Secretary for Security of the HKSAR Government. Mott MacDonald Hong Kong Limited (MMHK) has in turn been commissioned by ArchSD as the consulting engineer for the entire Project under Consultancy Agreement No. 9SN005, and is the Engineer's Representative (ER) for construction of the Project.

In April 2015, ArchSD issued Works Order No. ASD011777 incorporating the improvement works for boundary fence at Mai Po, Lok Ma Chau and Sha Tau Kok for Phase 1, Quotation Contract No. 002/15/PMB203 covering landscape works at Tak Yuet Lau for Phase 2 to Lanon Development Limited (LANON) and Wah On Garden Landscaping Limited (WAH ON) ("The Contractors") respectively.

In August 2015, ArchSD issued Works Order No. ASD 011783 for the Demolition Works of Vehicle Inspection Shelter and Shek Chung Au Check Post at Sha Tau Kok to LANON.

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016



In April 2016, ArchSD issued Works Order No. ASD011794 incorporating the demolition works of existing security facilities from Lo Wu to Sha Tau Kok to LANON. The commencement date of this work is on 1 June 2016.

MMHK and Ramboll Environ Hong Kong Limited (Ramboll Environ) have been commissioned as the ET and IEC respectively to undertake the Environmental Monitoring and Audit (EM&A) programme as described in the approved EM&A Manual of the Project.

This monthly EM&A report summarises the environmental monitoring and audit works, list of activities and mitigation measures implemented for the aforementioned Works Orders (referred to hereafter as the “subject works”) during the period of 1 to 30 June 2016 inclusive (‘reporting month’).

The scope of works for improvement works for boundary fence at Mai Po, Lok Ma Chau and Sha Tau Kok consists of:

Mai Po Section:

- Replacement of hinges at gate no. 102C, 102B, 102A, 101K, 101J, 101I, 101H, 99E, 99A, 98 (Total 10 nos.)
- Installation of additional CCTV information plates at Gate no. 99D, 99G, 100A, 100B, 100E, 100G, 101B, 101C, 101D, 101E, 101G (Total 11 nos.)
- Removal of existing vegetation and top soil and provision 75mm thick concrete slab on verge area between fence kerb and road kerb along SBF
- Modification of gate no. 101K including installation of additional horizontal support and 6 nos. additional heavy duty hydraulic wheels
- Removal of existing vegetation and top soil and construction concrete pavement at gate no. 100D and 100H
- Installation of EPDM gasket for 150X150 opening at the various gates
- Trimming down of existing pavement outside Pak Hok Chau Checkpoint and installation anti-slip tiles with same FFL with existing

Lok Ma Chau Section:

- Replacement installed information plate at gate no. 78, 78B, 81A, 89A, 91A, 96A, 97 (Total 7 Nos.)
- Installation additional information plate for gate no. 91A and 91B
- Installation of 8 nos. of “No climbing” warning signs on the railing at DSD Maintenance Road Behind Ng Tung River
- Construction of 4 nos. of “Fish Convex Mirror” and the associated installation works

Sha Tau Kok Section:

- Installation of 2 nos. anti-mosquito lantern for booths of vehicular inspection shelter and 2 nos. anti-mosquito lantern for gate 1 checkpoint
- Installation of anti-slip tiles at vehicular inspection shelters
- Construction of ramp, handrail and stainless steel wire mesh guard at gate 1 checkpoint
- Installation of CCTV plates at gate M/P4-2, gate M/P4-7, gate besides waterfront, fence near CCTV post 26B in VHA, fence near CCTV post 20B in VHA, gate 6 at Shan Tsui Village and gate 7 at Shan Tsui Village
- Construction of additional lamp poles (Flood light) to replace the existing lamp
- Installation of additional information plates on pedestrian gate no. M/P4-7 and M/P4-2 at Sha Tau Kok
- Provision of FCA road marking at Sha Tau Kok

The scope of works for landscaping works at Tak Yuet Lau consists of:

- Site boundary setting-out
- Site clearance
- Import of soil mix
- Hydroseeding
- Planting of trees
- Staking support the new planted tree
- Planting of shrubs
- Mulching
- Dress up the site

The scope of works for Demolition Works of Vehicle Inspection Shelter and Shek Chung Au Check Post at Sha Tau Kok consists of:

- Removal of Existing C&ED and HKPF Check Post
- Removal of Vehicle Inspection Shelter

The scope of works for Demolition of Existing Security Facilities from Lo Wu to Sha Tau Kok consists of:

- To remove existing Vehicle Inspection Shelter and Police Post at Sha Ling
- To remove existing Vehicle Inspection Shelter and Police Post at Ping Che
- To remove existing boundary fences and associated facilities in 2 sections of road connecting between 2 ends of New Patrol Road and existing Lin Ma Hang Road.
- To remove Post 16, existing 24 nos. of FCA signage and associated supporting
- To replace 3 nos. of signage with a new plate
- To reinstate the surface works areas
- To divert switch room no. 4 and the associated cable ducts and power cables and provide new pillar boxes and drawpits to suit new cable ducts

1.2 Project Organisation

The organisation chart and lines of communication with respect to the on-site environmental management structure together with the contact information of the key personnel are shown in [Appendix B](#).

1.3 Works Undertaken in the Reporting Month

The following activities have taken place during the reporting month:

Improvement Works for Boundary Fence at Mai Po, Lok Ma Chau and Sha Tau Kok:

Note: All improvement works have been completed. ArchSD issued a letter on 8 December 2015 certifying that the improvement works (Works Order No. ASD011777) were substantially completed on 13 November 2015. Minor works for defects rectification were completed in the week ending 12 December 2015.

Landscaping Work at Tak Yuet Lau:

- Maintenance of trees and shrubs

Demolition Works at Shek Chung Au:

216727/307/16/EM&A(2016-06) July 2016

P:\Hong Kong\INF\Projects\216727-Boundary Fence\Environmental\Environmental Team\Phase 2\Deliverable\Monthly EM&A Report\2016-06\EM&A Report (June 2016) Rev A.doc

Construction of a Secondary Boundary Fence and New Sections of
Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at
Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



- Nil *

*Note: The remaining works at Shek Chung Au, namely removal of vehicle inspection shelter, were omitted from the relevant works order (No. ASD 011783) by ER's instruction on 1 March 2016. On the same day, ArchSD certified that Works Order No. ASD011783 was substantially completed on 3 February 2016. A proposal to suspend the EM&A programme at Shek Chung Au was prepared by ET on 7 March 2016, verified by IEC on 9 March 2016 and submitted to EPD on 10 March 2016. The EM&A programme at Shek Chung Au was suspended on 23 June 2016.

Demolition Works from Lo Wu to Sha Tau Kok:

- Demolition of Police Post and Inspection Shelter at Ping Che

2. EM&A Requirements

2.1 Summary of EM&A Requirements

The EM&A programme requires environmental monitoring of construction noise as well as environmental site inspections for air quality, noise, water quality, waste management, ecology, landscape and visual, as specified in the approved EM&A Manual.

Originally, the EM&A Manual designated ten locations as noise monitoring stations during the construction phase for the Project Sections. However, noise levels at only three monitoring stations (as shown in **Table 2.1.**) were included in current EM&A programme. The reasons for this arrangement are detailed in Section 3.2.

A summary of impact EM&A requirements is presented in **Table 2.1.** The Environmental Quality Performance Limits and the Event and Action Plans (for construction noise only) are shown in **Appendix C** and **Appendix D** respectively.

Table 2.1: Summary of EM&A Impact Requirements

Parameters	Description	Location(s)	Frequency	Duration
Air	On-site Inspection	Active Works Sites	Weekly	During Construction
Noise	L _{eq} , 30min	VH03 [#] , STK-ICHK* WL01(R)	Weekly	During Construction
Waste management	On-site Waste Audit	Active Works Sites	Weekly	During Construction
	On-site Waste Inspection			
Wastewater	On-site Wastewater Audit	Active Works Sites	Weekly	During Construction
Ecology	On-site Audit of Recommended Ecological Mitigation Measures	Active Works Sites	Periodically (by Contractor)	As specified in EM&A Manual (see Table E.5)
Landscape and Visual	On-site Audit of Recommended Landscape and Visual Mitigation Measures	Active Works Areas	Regular intervals (by Contractor/ Landscape Sub-Contractor)	As specified in EM&A Manual (see Table E.6)
General Site Conditions	Environmental Site Inspection	Works areas and areas affected by works	Weekly	During Construction

[#]Note: The improvement works (Works Order No. ASD011777) were substantially completed on 13 November 2015 certified by ArchSD. Termination of noise impact monitoring at VH03 and site inspection for improvement work at Section 1, 2 & 4 was proposed by ET and agreed by IEC on 30 December 2015.

*Note: For details of monitoring location STK-ICHK, please refer Section 3.

2.2 Implementation of Environmental Mitigation Measures

The Contractor is required to implement mitigation measures listed in the latest valid EP and FEP(s) (where applicable), EIA Report and EM&A Manual. During routine site inspections, the Contractor's implementation of mitigation measures, if any, are to be inspected and reviewed. A schedule of the implementation of mitigation measures identified at the EIA stage is given in **Appendix E.**

3. Noise Impact Monitoring

3.1 Monitoring Parameters, Frequency and Duration

Following the requirements in the EM&A Manual for noise, noise monitoring has to be carried out during the construction phase. Continuous noise monitoring for the A-weighted levels L_{eq} , L_{10} and L_{90} is undertaken once per every week during daytime hours (between 07:00 and 19:00) on normal weekdays.

Table 3.1 summarizes the monitoring parameters, frequency and duration of noise monitoring. The noise monitoring schedule during the reporting month is presented in **Appendix F**.

Table 3.1: Noise Monitoring Parameters, Frequency and Duration

Monitoring Station	Parameters	Frequency	Duration
VH03	L_{eq} , L_{90} & L_{10}	Once every week	30 min
STK-ICHK	L_{eq} , L_{90} & L_{10}	Once every week	30 min
WL01(R)	L_{eq} , L_{90} & L_{10}	Once every week	30 min

3.2 Monitoring Location

Originally, ten construction noise monitoring stations were proposed in the EM&A Manual for Section 1, 2, 3 and 4, namely: VH01 (Village House at Mai Po), VH03 (Village House at Mai Po), MTL01 (Village House at Ma Tso Lung), LW02 (House No. 39 at Lo Wu), MW02 (House No. 11, Muk Wu Chuen Yiu), CY01 (House No. 19, Chuk Yuen), WL01 (Village House at Wang Lek), WL03 (Village House at Wang Lek), STK03 (Block 1, Sha Tau Kok Estate) and STK05 (Village House at Sha Tau Kok).

For Section 1, 2 and 4, as the major construction of the fencing has been conducted in earlier stages of Phase 1, the improvement works as mentioned in Section 1.1 are minor works unlikely to produce significant impact on the NSRs, except for the construction of concrete pavement in Section 1. With regard to the improvement works, only VH03 is proposed as a noise impact monitoring station.

STK03 was mainly selected for the construction works related to the SBF and the new checkpoint and kiosk/guard house in Sha Tau Kok, while STK05 was mainly selected for the removal of the existing checkpoint at Shek Chung Au.

However, access to STK03 to perform noise monitoring was not granted, therefore an alternative nearby location – STK-DBD (HKPF Operation Base, Sha Tau Kok Division, Border District) – was proposed by ET and agreed to by IEC and EPD. Baseline and impact noise monitoring was conducted at STK-DBD from 16 to 29 March 2010 and from June 2010 to January 2012 respectively.

Baseline monitoring at STK05 was conducted from 7 to 20 September 2012. No impact noise monitoring at STK05 has been carried out at this stage.

The baseline noise monitoring location for the demolition work of existing checkpoint at Shek Chung Au was recently reviewed. An updated baseline monitoring report was submitted to EPD in early November 2015 proposing an alternative noise monitoring station (STK-ICHK) which is located closer to the

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016



demolition work area. The noise monitoring station is relocated from STK05 to STK-ICLK for monitoring the noise impact from the demolition work.

The demolition work at Shek Chung Au commenced on 14 November 2015 and the weekly impact noise monitoring at STK-ICLK started on 16 November 2015.

For demolition works from Lo Wu to Sha Tau Kok, which are within Section 3 of the Project, only WL01 is required for noise monitoring for the demolition works of existing fencing at Lin Ma Ha according to the approved SBF EIA (Ref. No.: AEIAR-136/2009).

According to the baseline monitoring report conducted by ETS-Testconsult Limited in 2012, the baseline monitoring at WL01 was blocked by others for other use and access to WL01 was rejected. An alternative noise monitoring station WL01(R), which was located close to WL01 and relevant construction site, was proposed and agreed by IEC of the Project. Baseline monitoring at WL01(R) was conducted from 22 September 2012 to 5 October 2012.

As a result, three noise impact monitoring stations are included in the current EM&A programme for the subject works during the reporting period. The locations of the agreed noise monitoring stations are listed in **Table 3.2** and shown in **Figure 2.1**, **Figure 2.2** and **Figure 2.3**.

Table 3.2: Noise Impact Monitoring Location

Monitoring Station	Description of Location	Type of measurement
VH03 [#]	Village House at Mai Po	Façade
STK-ICLK*	International College Hong Kong at Shek Chung Au	Façade
WL01(R)**	Village House at Wang Lek	Free Field [^]

[#]Note: The improvement works (Works Order No. ASD011777) were substantially completed on 13 November 2015 certified by ArchSD. Termination of noise impact monitoring at VH03 and site inspection for improvement work at Section 1, 2 & 4 was proposed by ET and agreed by IEC on 30 December 2015.

*Note: The remaining works at Shek Chung Au, namely removal of vehicle inspection shelter, were omitted from the relevant works order (No. ASD 011783) by ER's instruction on 1 March 2016. On the same day, ArchSD certified that Works Order No. ASD011783 was substantially completed on 3 February 2016. A proposal to suspend the EM&A programme at Shek Chung Au was prepared by ET on 7 March 2016, verified by IEC on 9 March 2016 and submitted to EPD on 10 March 2016. The EM&A programme at Shek Chung Au was suspended on 23 June 2016.

[^]Note: For noise monitoring station WL01(R), a 3dB(A) correction will be adopted to the result of the free-field noise measurement.

**Note: No impact monitoring was conducted at WL01(R) during the reporting period since demolition of existing boundary fence at Lin Ma Hang Road had not yet commenced.

3.3 Monitoring Equipment

Integrating Sound Level Meter will be used for noise monitoring. It is a Type 1 sound level meter capable of giving a continuous readout of the noise level readings including equivalent continuous sound pressure level (L_{eq}) and percentile sound pressure level (L_x). They comply with International Electrotechnical

Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1). **Table 3.3** summarizes the typical noise monitoring equipment used.

Table 3.3: Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-31
Acoustic Calibrator	Castle GA607

3.4 Equipment Calibration

The calibration frequencies of the monitoring equipment are provided in **Table 3.4**.

Table 3.4: Noise Monitoring Equipment Calibration Frequencies

Equipment, Model and Serial Number	Calibration Frequency
Integrating Sound Level Meter	Every year
Acoustic Calibrator	Every year

The noise monitoring equipment calibration certificates are presented **Appendix G** in this report.

3.5 Monitoring Methodology

3.5.1 Field Monitoring

- The Sound Level Meter was set on a tripod at a height of at least 1.2 m above the ground.
- Façade measurements were made at the monitoring locations.
- The battery condition was checked to ensure the correct functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting: A
 - time weighting: Fast
 - time measurement: 5-minute intervals (between 07:00 and 19:00); L_{eq} (30 min) was determined by calculating the logarithmic average of six L_{eq} (5-min) data.
- Prior to and after each noise measurement, the meter was calibrated using a Calibrator for 94 dB at 1 kHz. If the difference in the calibration level before and after measurement was more than 1 dB, the measurement would be considered invalid and have to be repeated after re-calibration or repair of the equipment.
- During the monitoring period, the L_{eq} , L_{10} and L_{90} noise levels were recorded. In addition, any site observations and noise sources were recorded on a standard record sheet.

3.5.2 Maintenance and Calibration

- The microphone head of the sound level meter and calibrator is cleaned with soft cloth at quarterly intervals.
- The meter and calibrator are sent to the supplier or Hong Kong Laboratory Accreditation Scheme (HOKLAS) laboratory to check and calibrate at yearly intervals.

3.6 Results of Impact Monitoring

Noise impact monitoring was conducted at STK-ICHK on 3, 10 and 17 June 2016 during the reporting month. The EM&A programme at Shek Chung Au, including the abovementioned noise impact monitoring, was suspended on 23 June 2016.

The measured construction noise level, in terms of L_{eq} (30-min), during the reporting month are summarised in **Table 3.5**.

Table 3.5: Result of Noise Impact Monitoring

Monitoring Station	Measured L_{eq} (30-mins) Range, dB(A)	Limit Level for L_{eq} , dB(A)
STK-ICHK	67-69	70

No exceedances of Action or Limit Level for construction noise were recorded at STK-ICHK during the reporting month.

The graphical presentations of the measured construction noise level of the reporting month of noise impact monitoring are presented in [Appendix H](#). The general weather conditions and graphical presentation are presented in **Appendix K**.

3.7 Exceedance Investigation and Findings

During June 2016, no exceedances of Action or Limit Level for construction noise were recorded.

4. Environmental Site Inspection and Audit

4.1 Site Inspections

Environmental site inspections were carried out on a weekly basis to monitor the proper implementation of environmental pollution control and mitigation measures for the subject works.

In the reporting month, one monthly site inspection was carried out jointly by the ER, Contractor, ET and IEC on 3 June 2016. Weekly site inspections were carried out by ET at Tak Yuet Lau (on 3, 10, 17, 24 and 30 June 2016), Demolition work at Shek Chung Au (on 3, 10, and 17 June 2016) and Demolition work at Ping Che (on 3, 10, 17, 24 and 30 June 2016). The EM&A schedule is presented in **Appendix F**.

Major findings provided by ET during the weekly site inspections are summarised in **Table 4.1**. In general, the works site areas were found to be in compliance with the environmental mitigation requirements listed in the EM&A Manual and no adverse impacts were found.

Note:

-The EM&A programme at Shek Chung Au was suspended on 23 June 2016.

Table 4.1: Summary of Environmental Site Inspections

Date of Inspection	Major Observations	Status
3 June 2016	<u>Tak Yuet Lau:</u> No major observations.	-
	<u>Demolition work at Shek Chung Au:</u> No major observations.	-
	<u>Demolition works at Ping Che:</u> No major observations.	-
10 June 2016	<u>Tak Yuet Lau:</u> Two broken trunk trees (LF T039 and LF T009) were observed. Remove and replace those trees are recommended.	(On-going)
	<u>Demolition work at Shek Chung Au:</u> No major observations.	-

Date of Inspection	Major Observations	Status
	<u>Demolition works at Ping Che:</u>	
	1. <u>Hydraulic breaker in operation for site clearance was observed. The Contractor was reminded to use hand-held breaker for demolition work to fulfill the EM&A requirement.</u>	1. No operation of hydraulic breaker was observed. All major demolition works have been completed. (Closed 17 June 2016)
	2. <u>Temporary C&D materials stored on site was observed. The Contractor was reminded to clear all C&D waste as soon as possible to prevent site runoff during raining.</u>	2. C&D material stored on site was observed. The Contractor was reminded to provide cover to the C&D material to prevent site runoff during raining (On-going 17 June 2016)
	3. <u>No noise barrier/ other noise protection measures set up between village house and the project site was observed. The Contractor was reminded to provide appropriate noise mitigation measures to fulfill the EM&A requirement during demolition work..</u>	3. All major demolition works have been completed (Closed 17 June 2016)
17 June 2016	<u>Tak Yuet Lau:</u> No new observations.	-
	<u>Demolition work at Shek Chung Au:</u> No major observations.	-
	<u>Demolition works at Ping Che:</u>	
	1. C&D material stored on site was observed. The Contractor was reminded to provide cover to the C&D material to prevent site runoff during raining	1. No storage of C&D material on site was observed. (Closed 24 June 2016)
24 June 2016	<u>Tak Yuet Lau:</u> No new observations.	-
	<u>Demolition works at Ping Che:</u> No major observations.	-
30 June 2016	<u>Tak Yuet Lau:</u> No new observations.	-
	<u>Demolition works at Ping Che:</u> No major observations.	-

4.2 Environmental Meetings

No environmental meeting was held during the reporting month.

4.3 Status of Environmental Submissions, Permits and Licences

A summary of status of all environmental submissions, valid permits/licences, and/or notifications to EPD for this Project during the reporting month is presented in **Table 4.2**.

Table 4.2: Status of Environmental Permits and Licences

Statutory Reference	Description	Permit / Reference No.	Status
EIAO	Environmental Permit	EP-347/2009/A	Valid
WDO	Bill Account Disposal	7021313	Valid
Legend:	EIAO –	Environmental Impact Assessment Ordinance	
	WDO –	Waste Disposal Ordinance	

216727/307/16/EM&A(2016-06) July 2016

P:\Hong Kong\INF\Projects\216727-Boundary Fence\Environmental\Environmental Team\Phase 2\Deliverable\Monthly EM&A Report\2016-06\EM&A Report (June 2016) Rev A.doc

Note: The Bill Account Disposal for Contract No. TCC508 was registered by the Lanon Development Limited.

4.4 Advice on the Solid and Liquid Waste Management Status

The construction and demolition (C&D) material and general refuse generated by the subject works of the Project in the reporting month are shown in **Appendix I**. Wastes were handled and disposed from site in accordance with the EM&A Manual and all relevant legislation and regulations.

4.5 Review of Environmental Monitoring Procedures

The monitoring works conducted by the Environmental Team have been reviewed regularly. No changes in the environmental monitoring procedures are considered necessary at this stage.

4.6 Implementation Status of Environmental Mitigation Measures

An Implementation Schedule of Mitigation Measures from the EIA Report / EM&A Manual is provided in **Appendix E**, in the following order (see **Table 4.3**):

Table 4.3: Implementation Schedule of Mitigation Measures

Parameter	Table	Parameter	Table
Air Quality	Table E.1	Waste Management	Table E.4
Noise	Table E.2	Ecology	Table E.5
Water Quality	Table E.3	Landscape and Visual	Table E.6

5. Record of Non-compliance, Complaints, Notifications of Summons and Successful Prosecutions

5.1 Non-compliance of Action and Limit Levels

There was no breach of Action or Limit Level for construction noise impact monitoring detected during the reporting month.

5.2 Environmental Complaints

No environmental complaints were received or made against the subject works of the Project during the reporting month. The complaint log is presented in **Appendix J**.

5.3 Notifications of Summons and Successful Prosecutions

No notifications of summons or successful prosecution were received or made against the subject works of the Project during the reporting month.

5.4 Review of Reasons for and Implication of Non-compliance, Complaints, Summons and Prosecutions

Non-compliance

There was no non-compliance issue during the reporting month.

5.5 Follow-up Actions Taken

Follow-up actions have been taken during the reporting month. Action taken mainly include clearance of C&D materials storage on site. For details, please refer to **Section 4.1**.

6. Future Key Issues

6.1 Construction Programme for the Next Reporting Month

The major construction works forecast for the subject works in July 2016 will include:

Improvement Works for Boundary Fence at Mai Po, Lok Ma Chau and Sha Tau Kok

Mai Po Section:

- Nil (work in this section completed)

Lok Ma Chau Section:

- Nil (work in this section completed)

Sha Tau Kok Section:

- Nil (work in this section completed)

Landscaping Works at Tak Yuet Lau

- Maintenance of trees and shrubs

Demolition Works at Shek Chung Au

- Nil*

*Note: The remaining works at Shek Chung Au, namely removal of vehicle inspection shelter, were omitted from the relevant works order (No. ASD 011783) by ER's instruction on 1 March 2016. On the same day, ArchSD certified that Works Order No. ASD011783 was substantially completed on 3 February 2016. A proposal to suspend the EM&A programme at Shek Chung Au was prepared by ET on 7 March 2016, verified by IEC on 9 March 2016 and submitted to EPD on 10 March 2016. The EM&A programme at Shek Chung Au was suspended on 23 June 2016.

Demolition Works from Lo Wu to Sha Tau Kok:

- Reinstate the surface works areas at Ping Che.
- Demolition of Vehicle Inspection Shelter and Police Post at Sha Ling (tentative)

6.2 Key Issues for the Next Reporting Month

Future key issues to be considered in the forthcoming month include:

Air Quality

- Any excavated dusty materials or stockpile of dusty material should be covered by impervious sheeting or sprayed with water.

Noise Impact

- Noisy equipment and noisy activities should be located as far away from Noise Sensitive Receivers;
- Avoiding the operation of unused equipment, and minimising the use of Powered Mechanical Equipment (PME) and parallel use of noisy equipment/ machinery; and
- Regular maintenance of all plant and equipment.

216727/307/16/EM&A(2016-06) July 2016

P:\Hong Kong\INF\Projects\216727-Boundary Fence\Environmental\Environmental Team\Phase 2\Deliverable\Monthly EM&A Report\2016-06\EM&A Report (June 2016) Rev A.doc

Water Quality

- No discharge of silty water into storm drain and drainage channel within the vicinity of the site.

Waste

- Keeping of records of quantities of wastes generated, recycled and disposal (with locations); and
- Segregation, storage, transportation and disposal of different types of waste.

Ecology

- Good site practices for controlling the dust and water quality; and
- Clear definition of works limit to avoid impact on adjacent habitats.

Landscape and Visual

- Retain tree with high amenity or ecology value and contributing most to landscape and amenity of site.

Environmental mitigation measures will be implemented on site as recommended and weekly site audits will be carried out to ensure that the environmental conditions are acceptable.

6.3 Monitoring Schedule for the Next Reporting Month

The tentative schedule for environmental site inspection in July 2016 is provided in **Appendix F**. Actual dates may change due to unforeseen events such as inclement weather.

7. Conclusions and Recommendations

7.1 Conclusions

The construction phase EM&A programme for the subject works was performed from 1 to 30 June 2016 (except at Shek Chung Au which was suspended on 23 June 2016) during which landscaping maintenance works at Tak Yuet Lau, and demolition works from Lo Wu to Sha Tau Kok were conducted. All monitoring and audit results and findings in the reporting month were checked and reviewed.

Weekly construction noise monitoring was carried out in the reporting month for demolition work at Shek Chung Au until 23 June 2016. No exceedance of the noise Limit Level was recorded. Furthermore, no noise-related complaint was received or followed-up by ET during the reporting month, therefore no Action Level exceedance was recorded.

Environmental site inspections were carried out at Tak Yuet Lau, Shek Chung Au (until 23 June 2016) and Ping Che sites during the reporting month. During the site audits, recommendations on remedial actions were given to the Contractor for any deficiencies identified.

Wastes were handled and disposed from site in accordance with EM&A Manual and all relevant legislation and regulations.

No environmental complaints, notification of summons of successful prosecutions were received or made against the subject works of the Project during the reporting month.


7.2 Recommendations

Improvements in the implementation of mitigation measures with respect to air quality, water quality, noise and waste management were recommended based on the deficiencies identified during environmental site audits in the reporting month. No further recommendations were made at this stage based on the monitoring and audit findings.



圖例：
LEGEND:

- 建議於現有邊界巡邏通路興建的輔助邊界圍網
PROPOSED SECONDARY BOUNDARY FENCE
ALONG EXISTING BOUNDARY PATROL ROAD
- 建議的主要及輔助邊界圍網及新邊界巡邏通路
PROPOSED NEW BOUNDARY PATROL ROAD WITH
PRIMARY AND SECONDARY BOUNDARY FENCES
- 擬將移除的現有邊界圍網
EXISTING BOUNDARY FENCE TO BE REMOVED

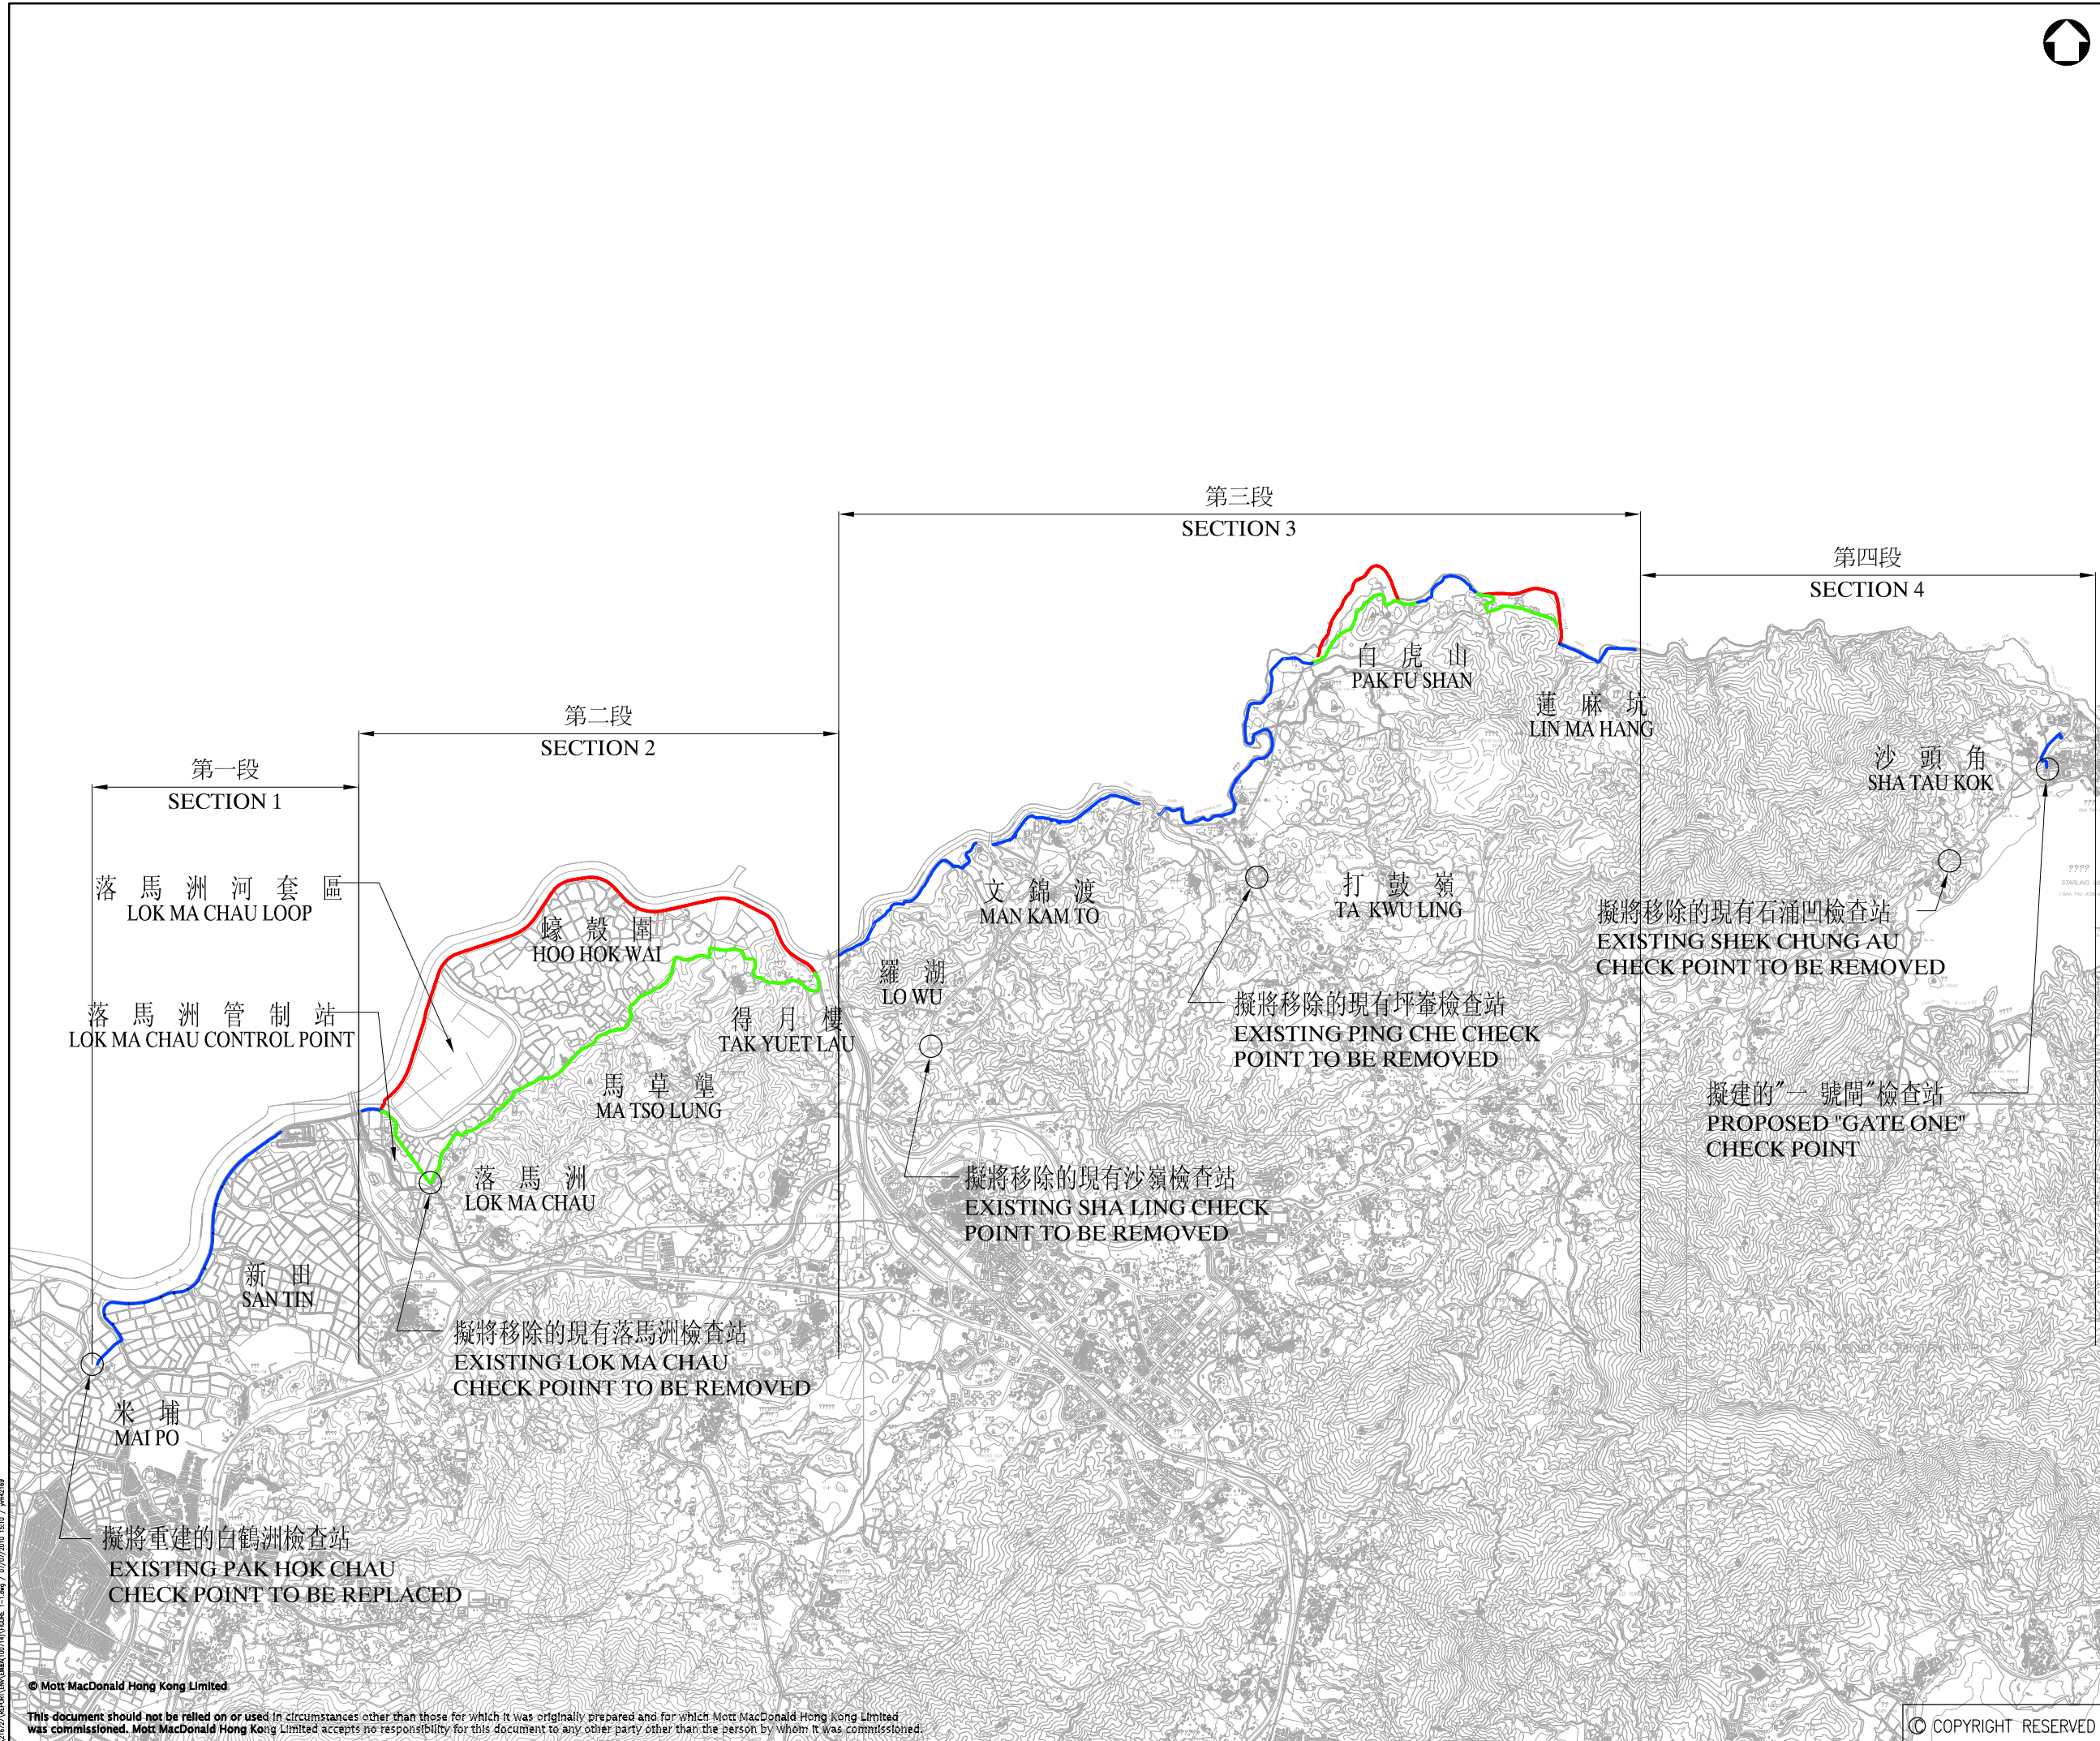

P1	JUL 10	AT	FIRST ISSUE	BW	TI
Rev	Date	Drawn	Description	Ch'k'd	App'd

ARCHITECTURAL SERVICES DEPARTMENT


Mott MacDonald

20/F Two Landmark East
100 Hoi King Street
Kowloon Tong, Kowloon
Hong Kong
T +852 2828 8707
F +852 2827 1823
W www.mottmac.com.hk

Project
CONSTRUCTION OF A SECONDARY BOUNDARY FENCE AND NEW SECTIONS OF PRIMARY BOUNDARY FENCE AND BOUNDARY PATROL ROAD

Title
概覽圖
GENERAL LAYOUT PLAN

Designed	WHC	Eng.Chk.	WHC	
Drawn	MCL	Coordination	WHC	
Dwg.Chk.	WHC	Approved	TI	
Scale	Project 216727		Status	
	N.T.S.		CAD File	INF
Drawing No.	216727/REPORT/DWG/DM&A(100714)/FIGURE 1-1.dwg		Rev	
	FIGURE 1.1 (圖 1.1)		P1	

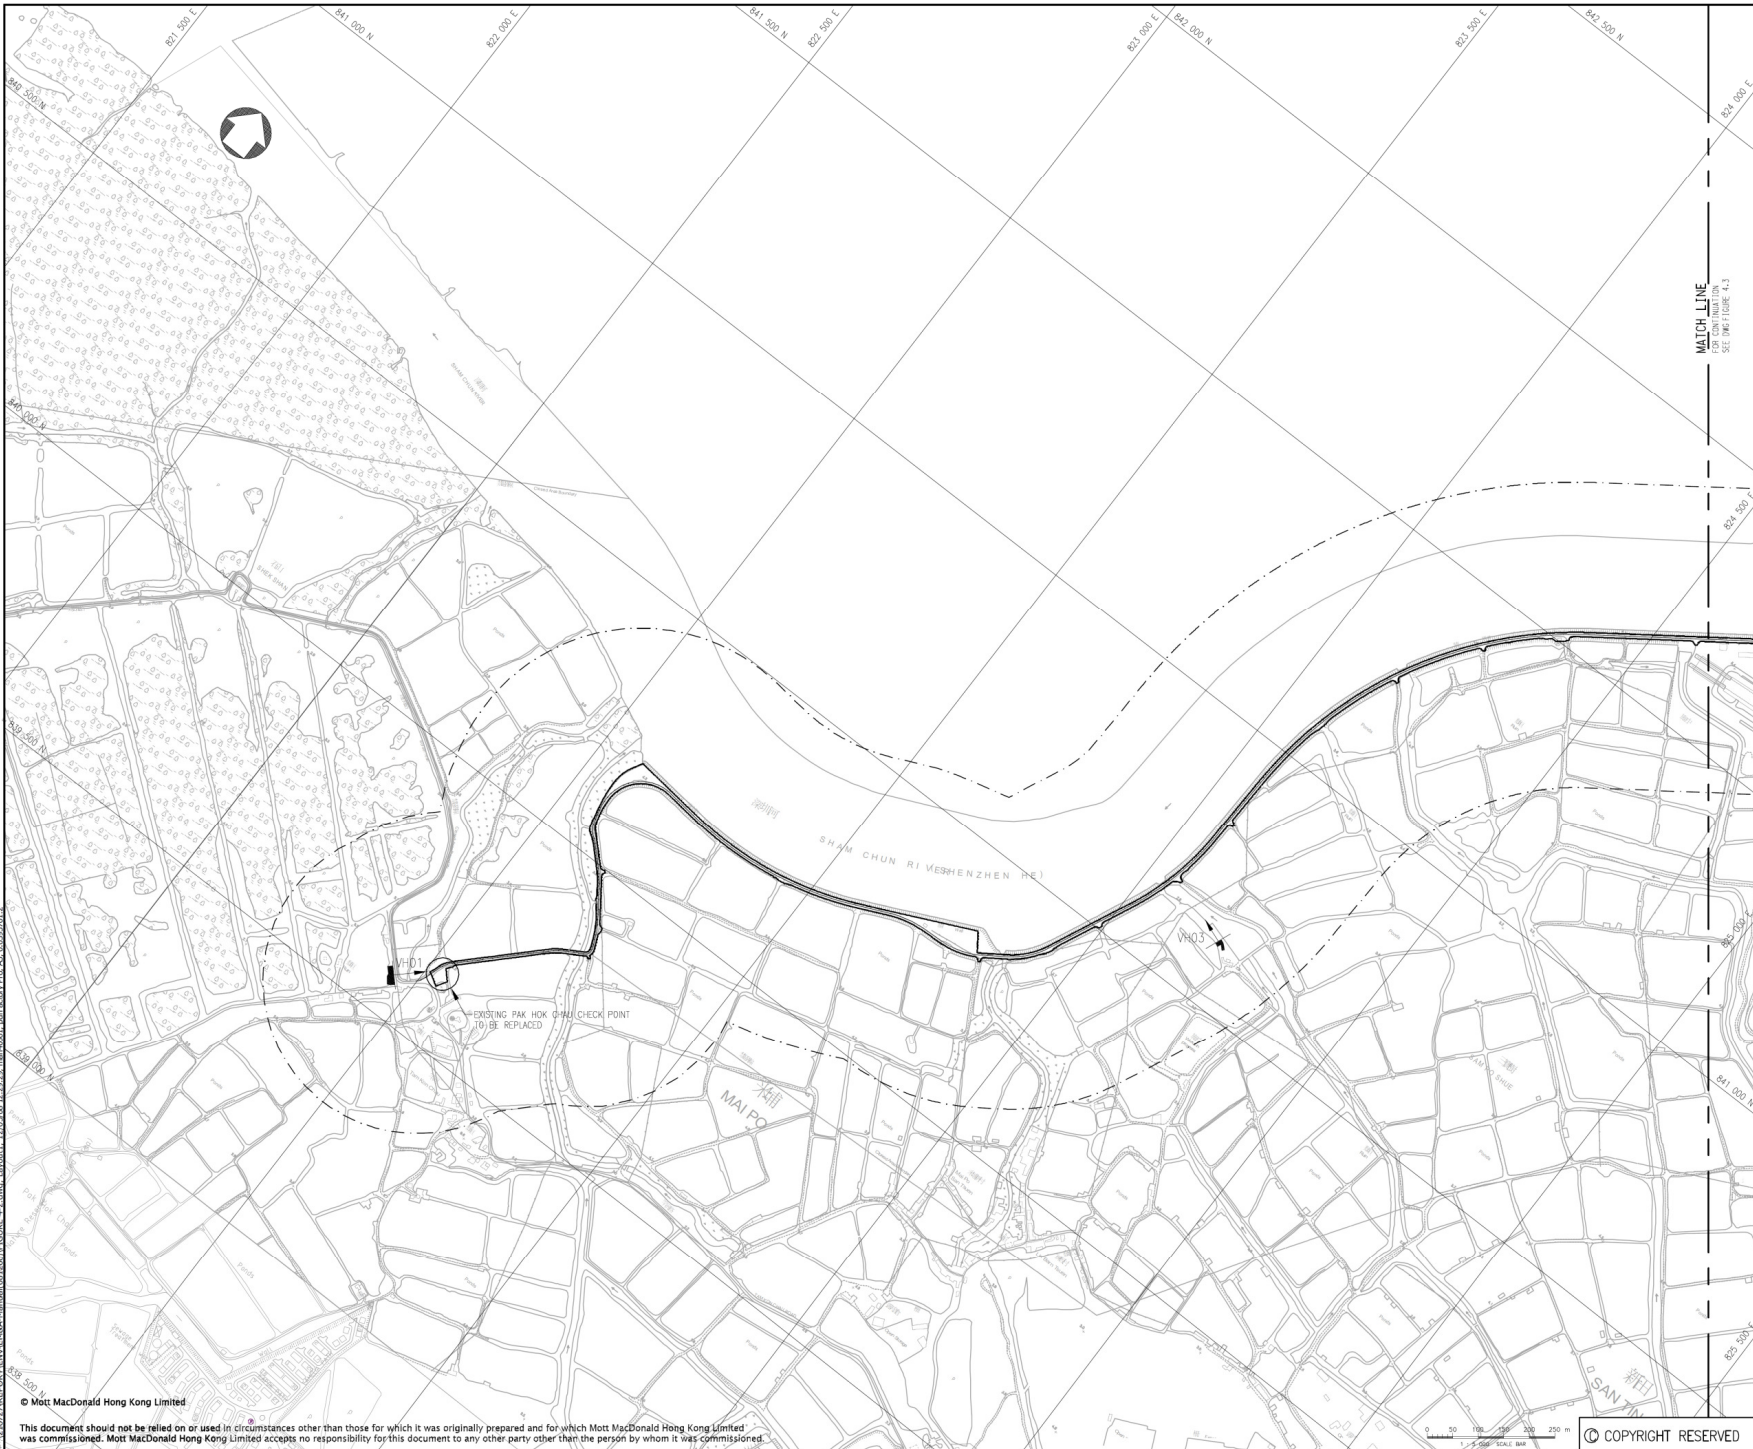

LEGEND :

	300m ASSESSMENT AREA
	NOISE SENSITIVE RECEIVER
	FACADE FACING

P2	DEC 08	MING	FORMAL SUBMISSION	BL	AFK
P1	NOV 08	MING	ISSUE FOR COMMENT	BL	AFK
Rev	Date	Drawn	Description	Chk'd	App'd



Mott MacDonald
 Mott MacDonald Hong Kong Ltd
 7th Floor
 West Wing Office Building
 New World Centre
 27 Salisbury Road
 Tsim Sha Tsui, Kowloon
 Hong Kong
 Tel: 2828 5717
 Fax: 2827 1823
 Web: www.mottmac.com.hk

Project
CONSTRUCTION OF A SECONDARY BOUNDARY FENCE AND NEW SECTIONS OF PRIMARY BOUNDARY FENCE AND BOUNDARY PATROL ROAD

Title
LOCATION OF NOISE MONITORING STATIONS

Designed	BL	Eng. Chk.	W/C
Drawn	MING	Coordination	W/C
Eng. Chk.	BL	Approved	AFK
Scale	1 : 5000 @ A1	Project	216727
		CAD File	C:\31\6727\PROJECT\DWG\UNBA-Noise\081208\FIGURE 4-3.dwg
Drawing No.	FIGURE 2.1	Status	PRE




COPYRIGHT RESERVED

© Mott MacDonald Hong Kong Limited



This document should not be relied on or used in circumstances other than those for which it was originally prepared and for which Mott MacDonald Hong Kong Limited was commissioned. Mott MacDonald Hong Kong Limited accepts no responsibility for this document to any other party other than the person by whom it was commissioned.

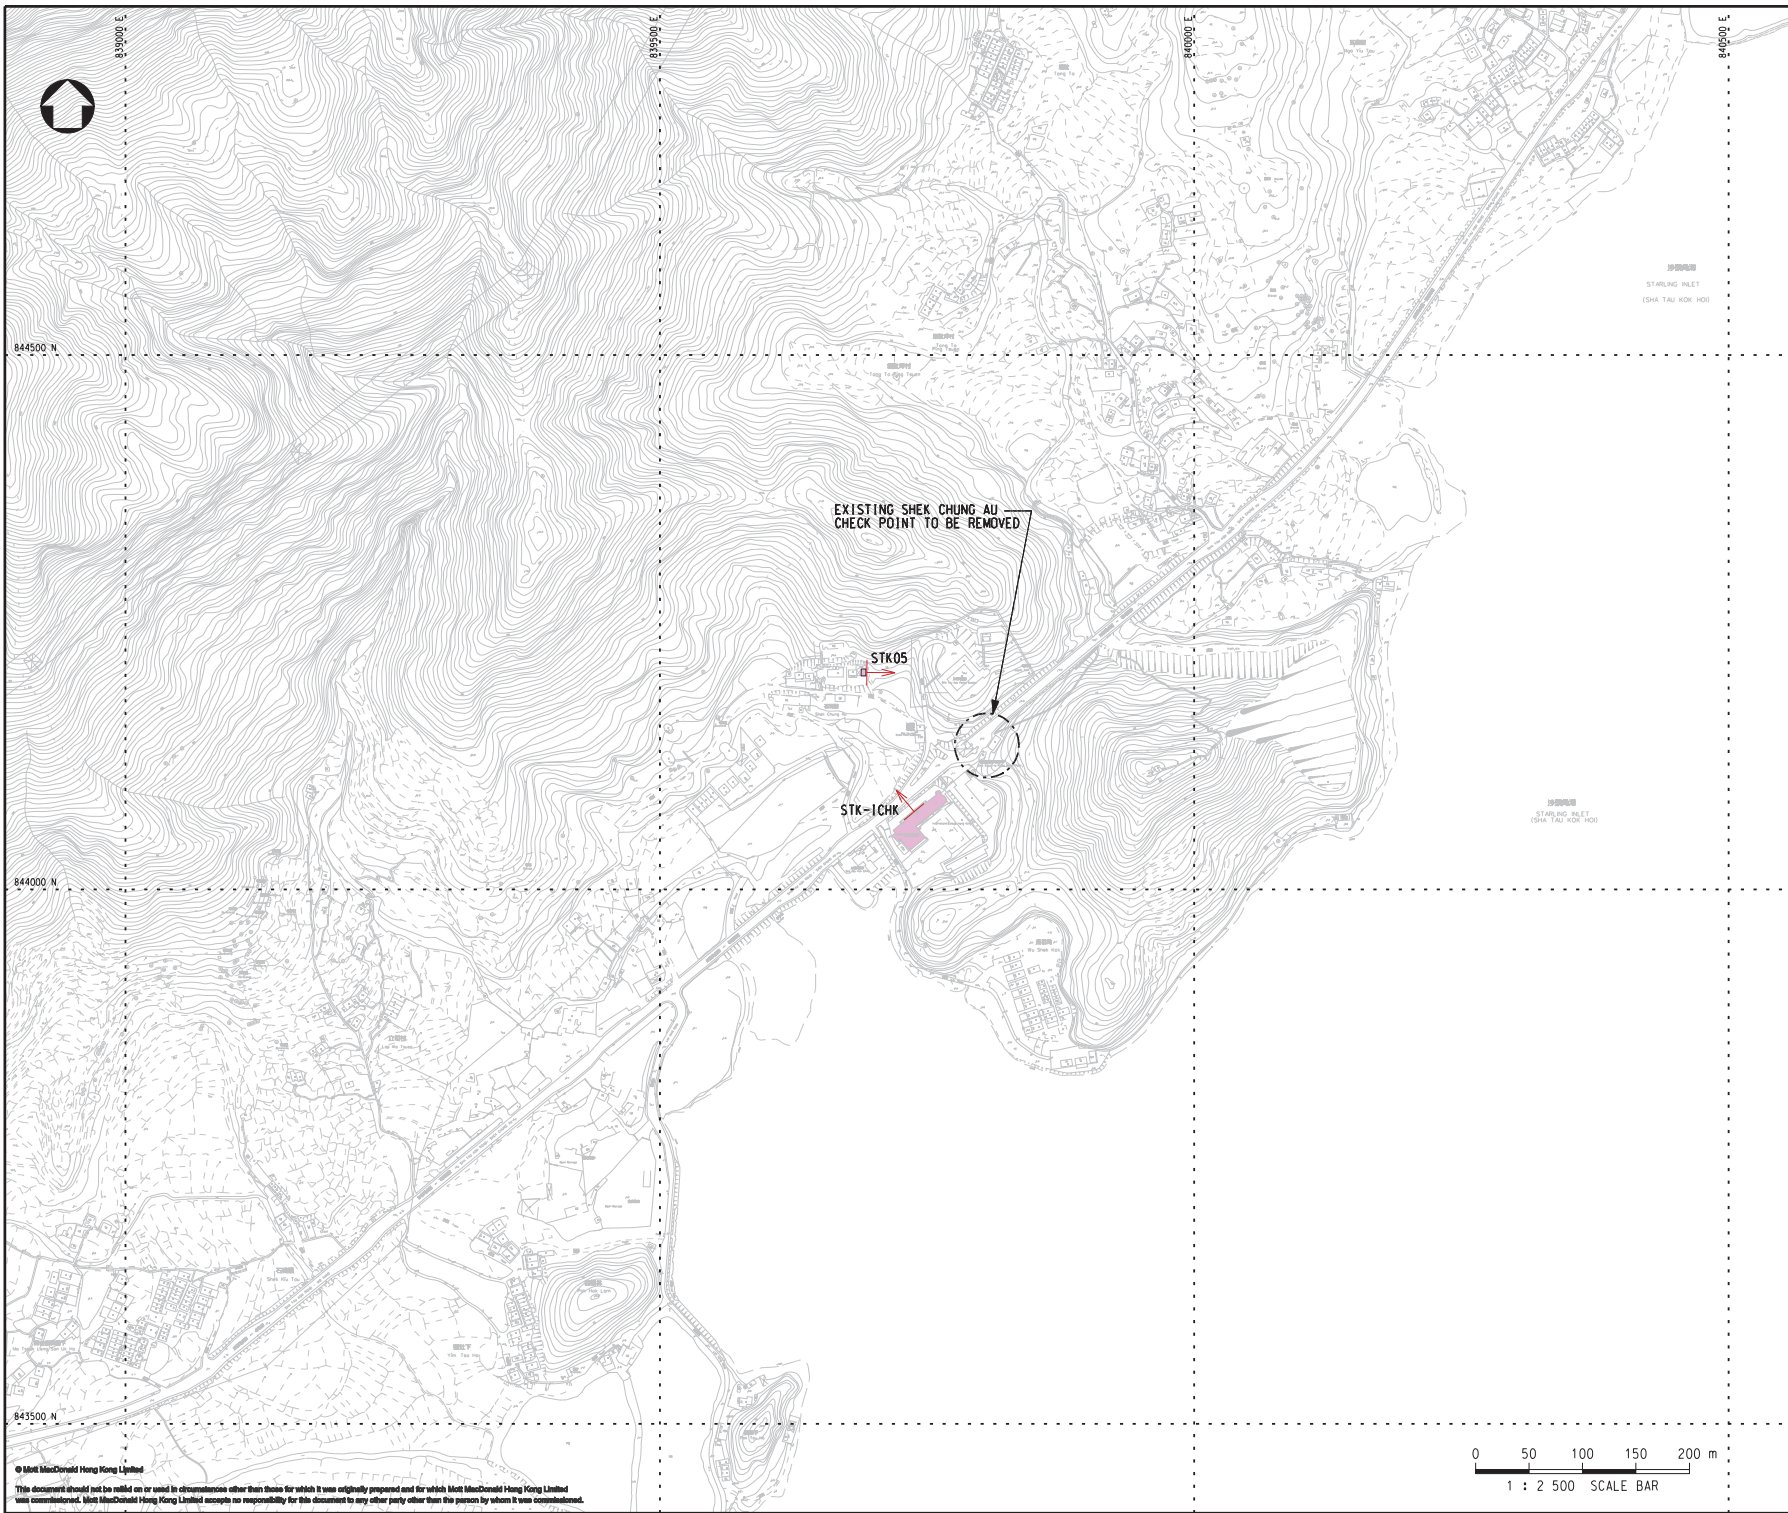C:\31\6727\PROJECT\DWG\UNBA-Noise\081208\FIGURE 4-3.dwg, Layout1, 2/25/2008, 12:29:29, m000501, m000501, P2, 0.0020112



Notes


Key to symbols

 NOISE SENSITIVE RECEIVER
 FACADE FACING

Reference drawings

Rev	Date	Drawn	Description	Ch'k'd	App'd
P1	NOV 15	MING	ISSUE FOR COMMENT	BW	JC

20/F AIA Kowloon Tower
Landmark East
100 How Ming Street
Kowloon Tong, Kowloon
Hong Kong
T +852 2828 8757
F +852 2827 1653
W www.mottmac.com.hk



Mott MacDonald

Client



ARCHITECTURAL SERVICES DEPARTMENT

Project


CONSTRUCTION OF A SECONDARY BOUNDARY FENCE AND NEW SECTIONS OF PRIMARY BOUNDARY FENCE AND BOUNDARY PATROL ROAD


Title

LOCATION OF NOISE MONITORING STATION FOR DEMOLITION OF SHEK CHUNG AU CHECK POINT

Designed	SC	Eng check	JC
Drawn	MING	Coordination	JC
Dwg check	SC	Approved	REV
Scale at A1	1:2500	Status	PRE
Drawing Number		Rev	P1

Figure 2.2

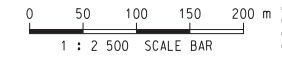

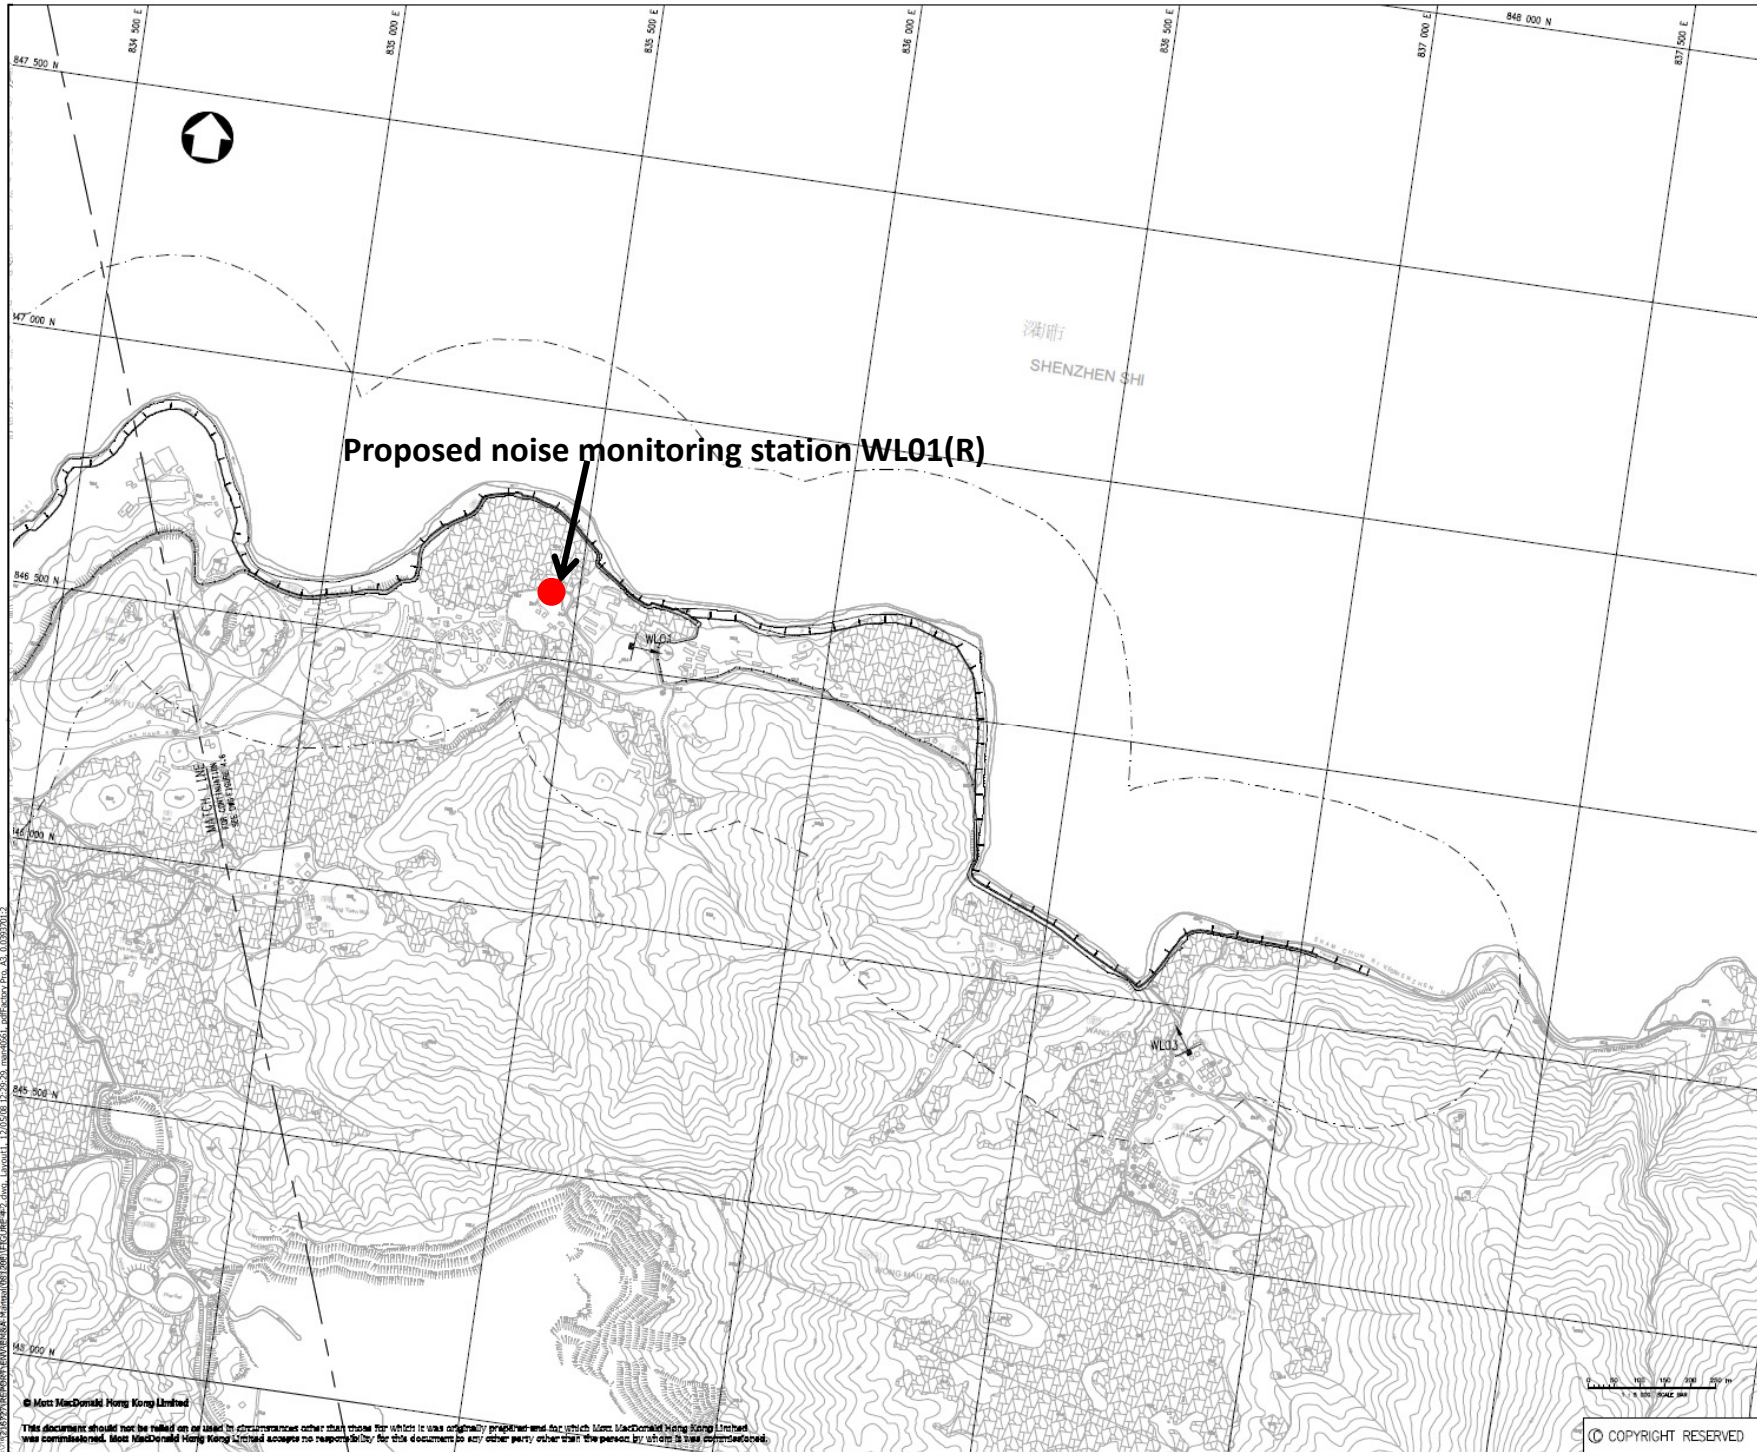

Proposed noise monitoring station WL01(R)

CONSTRUCTION OF A SECONDARY
BOUNDARY FENCE AND NEW SECTIONS
OF PRIMARY BOUNDARY FENCE
AND BOUNDARY PATROL ROAD

LOCATION OF NOISE MONITORING STATIONS

Designed	BL	Eng. Chk.	WHC
Drawn	MING	Coordination	WHC
Proj. Chk.	BL	Approved	AFK
Scale	Project	216727	Status
1 : 5000@A1	CAD File		PRE
Drawing No.	1/216727/PROJECT/001/000A-Noise@01200/0/0000-4-3-00		Rev
			P2



© COPYRIGHT RESERVED

FIGURE 2.3

© Mott MacDonald Hong Kong Limited
 This document should not be relied on or used in circumstances other than those for which it was originally prepared and for which Mott MacDonald Hong Kong Limited was commissioned. Mott MacDonald Hong Kong Limited accepts no responsibility for this document to any other party other than the person to whom it was commissioned.

Appendices

Appendix A. Construction Works Programme _____	18
Appendix B. Project Organisation Chart _____	19
Appendix C. Environmental Quality Performance Limits _____	20
Appendix D. Event and Action Plans _____	21
Appendix E. Schedule of Mitigation Measures from the EIA Report and EM&A Manual _____	22
Appendix F. EM&A Schedule _____	33
Appendix G. Calibration Certificates _____	35
Appendix H. Noise Monitoring Results and Graphical Presentation _____	36
Appendix I. Monthly Waste Flow Table _____	37
Appendix J. Complaint Log _____	38
Appendix K. Weather Information from Hong Kong Observatory _____	39


Construction of a Secondary Boundary Fence and New Sections of
Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at
Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



Appendix A. Construction Works Programme

ID	Task Name	Duration	Start	Finish	Gantt Chart											
					2nd Quarter			3rd Quarter			4th Quarter					
					A	M	J	J	A	S	O	N				
1	Works Order Period (Improvement Works for Boundary Fence at Mai Po, Lok Ma Chau and Sha Tau Kok)	184 days	Tue 28/4/15	Wed 28/10/15	28/4 ————— 28/10											
2	Works Order Commcement Date	0 days	Tue 28/4/15	Tue 28/4/15	◆ 28/4											
3	Mai Po Section	184 days	Tue 28/4/15	Wed 28/10/15	28/4 ————— 28/10											
4	1.) Replacement of Hinge at Gate no. 102C, 102B, 102A, 101K, 101J, 101I, 101H, 99E, 99A, 98 (Total 10 Nos.)	164 days	Tue 28/4/15	Thu 8/10/15	—————											
5	Material Procurement and Fabrication	104 days	Tue 28/4/15	Sun 9/8/15	—————											
6	Replacement of Hinge	60 days	Mon 10/8/15	Thu 8/10/15	—————											
7	2.) Installation Additional CCTV Information Plates at Gate no. 99D, 99G, 100A, 100B, 100E, 100G, 101B, 101C, 101D, 101E, 101G (Toal 11 Nos.)	127 days	Tue 28/4/15	Tue 1/9/15	—————											
8	Material Submission, Procurement and Fabrication	99 days	Tue 28/4/15	Tue 4/8/15	—————											
9	Installation of CCTV Information Plates	28 days	Wed 5/8/15	Tue 1/9/15	—————											
10	3.) Provision of Speed Limit Road Marking at Various Locations as Specified in the Drawings (Details to be Issued)	70 days	Mon 6/7/15	Sun 13/9/15	—————											
11	Material Submission	60 days	Mon 6/7/15	Thu 3/9/15	—————											
12	Provision FCA Road Marking	10 days	Fri 4/9/15	Sun 13/9/15	—————											
13	4.) Removal Existing Vegetation and Top Soil and Provision 75mm Thick Concrete Slab on Verge Area between Fence Kerb and Road Kerb along SBF	160 days	Tue 28/4/15	Sun 4/10/15	—————											
14	Application of Excavation Permit and Lead Time Waiver*	100 days	Tue 28/4/15	Wed 5/8/15	—————											
15	Construction of Concrete Slab on Verge Area	60 days	Thu 6/8/15	Sun 4/10/15	—————											
16	5.) Modification Gate no. 101K including Installation of Additional Horizontal Support and 6 nos. Additional Heavy Duty Hydraulic wheels	184 days	Tue 28/4/15	Wed 28/10/15	—————											
17	Material Submission, Procurement and Fabrication	100 days	Tue 28/4/15	Wed 5/8/15	—————											
18	Modification of Gate	20 days	Fri 9/10/15	Wed 28/10/15	—————											
19	6.) Removal Existing Vegetation and Top Soil and Construction Concrete Pavement at Gate no. 100D and 100H	174 days	Tue 28/4/15	Sun 18/10/15	—————											
20	Application of Excavation Permit and Lead Time Waiver	100 days	Tue 28/4/15	Wed 5/8/15	—————											
21	Detection Survey of Underground Utilities	2 days	Sat 3/10/15	Sun 4/10/15	—————											
22	Construction of Concrete Pavement	14 days	Mon 5/10/15	Sun 18/10/15	—————											
23	7.) Removal Existing Vegetation and Top Soil and Construction Concrete Pavement Run-in at Gate no. 100D and 100H	184 days	Tue 28/4/15	Wed 28/10/15	—————											
24	Application of Excavation Permit and Lead Time Waiver	100 days	Tue 28/4/15	Wed 5/8/15	—————											
25	Detection Survey of Underground Utilities	2 days	Sat 17/10/15	Sun 18/10/15	—————											
26	Construction of Concrete Pavement Run-in	10 days	Mon 19/10/15	Wed 28/10/15	—————											
27	8.) Installation of EPDM Gasket for 150x150 Opening at the Various Gates as per Sketch no. SK009	7 days	Mon 17/8/15	Sun 23/8/15	—————											
28	9.) Trimming Down Existing Pavement outside Pak Hok Chau Checkpoint and Installation Anti-slip Tiles with same FFL with Existing	44 days	Tue 15/9/15	Wed 28/10/15	—————											
29	Material Submission and Procurement	14 days	Tue 15/9/15	Mon 28/9/15	—————											
30	Trimming Down Existing Pavement and Installation of Anti-slip Tiles	30 days	Tue 29/9/15	Wed 28/10/15	—————											
31	Lok Ma Chau Section	184 days	Tue 28/4/15	Wed 28/10/15	28/4 ————— 28/10											
32	10.) Replacement Installed Information Plate at Gate no. 78, 78B, 81A, 89A, 91A, 96A, 97 as per Sketch no. SK046 (Total 7 Nos.)	141 days	Tue 28/4/15	Tue 15/9/15	—————											
33	Material Submission, Procurement and Fabrication	91 days	Tue 28/4/15	Mon 27/7/15	—————											
34	Installation of Information Plates	14 days	Wed 2/9/15	Tue 15/9/15	—————											
35	11.) Installation Additional Information Plate for Gate no. 91A and 91B as per Sketch no. SK047-048	146 days	Tue 28/4/15	Sun 20/9/15	—————											
36	Material Submission, Procurement and Fabrication	91 days	Tue 28/4/15	Mon 27/7/15	—————											
37	Installation of Information Plates	5 days	Wed 16/9/15	Sun 20/9/15	—————											

ID	Task Name	Duration	Start	Finish	2nd Quarter			3rd Quarter			4th Quarter				
					A	M	J	J	A	S	O	N			
38	12.) Installation 1 nos. Proposed Retractable Awning of approx. Size of 5m in width and 3m in Projection for Existing Canopy at Entrance of Tak Yuet Lau Police Post	114 days	Tue 28/4/15	Wed 19/8/15											
39	Material Submission, Procurement and Fabrication	100 days	Tue 28/4/15	Wed 5/8/15											
40	Installation of Proposed Retractable Awning	14 days	Thu 6/8/15	Wed 19/8/15											
41	13.) Installation 8 nos. of "No Climbing" Warning Signs on the Railing at DSD Maintenance Road Behind Ng Tung River	164 days	Tue 28/4/15	Thu 8/10/15											
42	Material Submission, Procurement and Fabrication	91 days	Tue 28/4/15	Mon 27/7/15											
43	Installation of Warning Signs	18 days	Mon 21/9/15	Thu 8/10/15											
44	14.) Construction 4 nos. of "Fish Convex Mirror" and the Associated Installation Works as per Sketch nos. SK052-054	184 days	Tue 28/4/15	Wed 28/10/15											
45	Application of Excavation Permit	100 days	Tue 28/4/15	Wed 5/8/15											
46	Material Submission, Procurement and Fabrication	30 days	Tue 7/7/15	Wed 5/8/15											
47	Detection Survey of Underground Utilities	2 days	Thu 6/8/15	Fri 7/8/15											
48	Installation of "Fish Convex Mirror" and Associated Installation Works	82 days	Sat 8/8/15	Wed 28/10/15											
49	Sha Tau Kok Section	184 days	Tue 28/4/15	Wed 28/10/15											
50	15.) Installation of 2 nos. Anti-mosquito Lantern for Booths of Vehicular Inspection Shelter and 2 nos. Anti-mosquito Lantern for Gate 1 Checkpoint G/F	114 days	Tue 28/4/15	Wed 19/8/15											
51	Material Submission, Procurement and Fabrication	100 days	Tue 28/4/15	Wed 5/8/15											
52	Installation of Anti-mosquito Lantern	14 days	Thu 6/8/15	Wed 19/8/15											
53	16.) Installation of Anti-slip Tiles at Vehicular Inspection Shelters	182 days	Tue 28/4/15	Mon 26/10/15											
54	Application of Excavation Permit	150 days	Tue 28/4/15	Thu 24/9/15											
55	Detection Survey of Underground Utilities	2 days	Fri 25/9/15	Sat 26/9/15											
56	Material Submission, Procurement and Fabrication	40 days	Thu 9/7/15	Mon 17/8/15											
57	Installation of Anti-slip Tiles	30 days	Sun 27/9/15	Mon 26/10/15											
58	17.) Construction Ramp, Handrail and Stainless Steel Wire Mesh Guard at Gate 1 Checkpoint	72 days	Tue 18/8/15	Wed 28/10/15											
59	Consent for Construction at Gate 1 Check Point from HKPF & C&ED	30 days	Tue 18/8/15	Wed 16/9/15											
60	Detection Survey of Underground Utilities	2 days	Thu 17/9/15	Fri 18/9/15											
61	Material Submission, Procurement and Fabrication	30 days	Thu 20/8/15	Fri 18/9/15											
62	Construction Ramp, Handrail and Stainless Steel Wire Mesh Guard	40 days	Sat 19/9/15	Wed 28/10/15											
63	18.) Installation CCTV Plates at Gate M/P4-2, Gate M/P4-7, Gate besides Waterfront, Fence near CCTV Post 26B in VHA, Fence near CCTV Post 20B in VHA, Gate 6 at Shan Tsui Village and Gate 7 at Shan Tsui Village	182 days	Tue 28/4/15	Mon 26/10/15											
64	Material Submission, Procurement and Fabrication	91 days	Tue 28/4/15	Mon 27/7/15											
65	Installation of CCTV Plates	18 days	Fri 9/10/15	Mon 26/10/15											
66	19.) Construction Additional Lamp Poles (Flood Light) to Replace the Existing Lamp as per Sketch no. SK017, 018A and 018B	184 days	Tue 28/4/15	Wed 28/10/15											
67	Application of Excavation Permit	130 days	Tue 28/4/15	Fri 4/9/15											
68	Material Submission, Procurement and Fabrication	100 days	Tue 28/4/15	Wed 5/8/15											
69	Construction Additional Lamp Poles	50 days	Sat 5/9/15	Sat 24/10/15											
70	Testing & Commissioning	4 days	Sun 25/10/15	Wed 28/10/15											
71	20.) Installation Additional Information Plates on Pedestrian Gate no. M/P4-7 and M/P4-2 at Sha Tau Kok	141 days	Tue 28/4/15	Tue 15/9/15											
72	Material Submission, Procurement and Fabrication	91 days	Tue 28/4/15	Mon 27/7/15											
73	Installation of Information Plates	10 days	Sun 6/9/15	Tue 15/9/15											
74	21.) Provision FCA Road Marking at Sha Tau Kok	71 days	Mon 6/7/15	Mon 14/9/15											
75	Material Submission	60 days	Mon 6/7/15	Thu 3/9/15											
76	Provision FCA Road Marking	1 day	Mon 14/9/15	Mon 14/9/15											

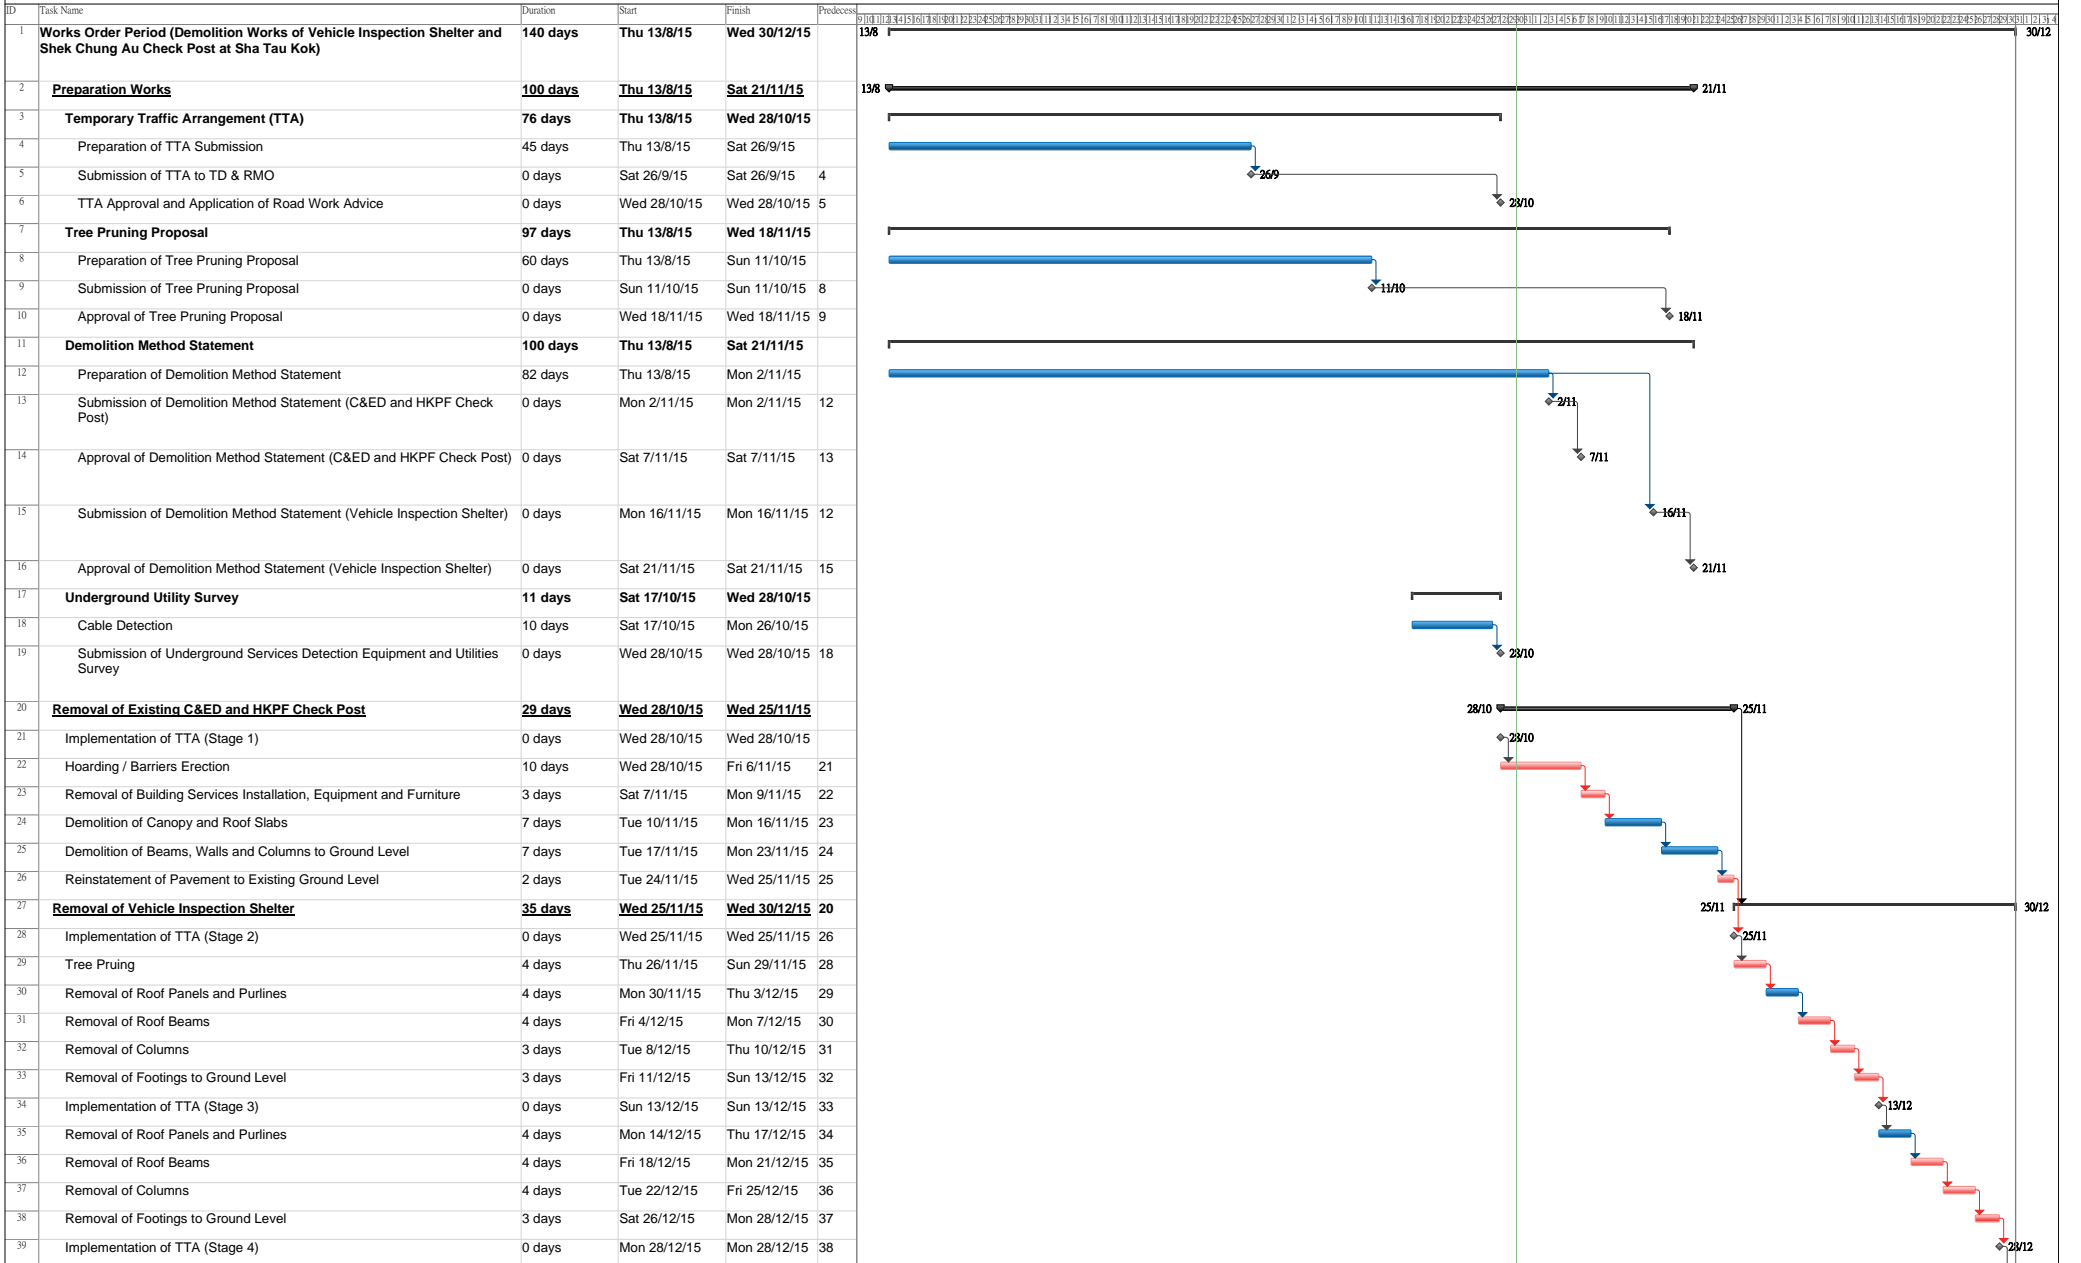

Project : Demolition Works of Vehicle Inspection Shelter and Shek Chung Au Check Post at Sha Tau Kok

ID	Task Name	Duration	Start	Finish	Predecessor
40	Reinstatement of Pavement to Existing Ground Level and Removal of Traffic Signs and Light and Water Tank behind	2 days	Tue 29/12/15	Wed 30/12/15	39

識別碼	Activity Description	Duration	Start	Finish	2016年5月				2016年7月				2016年9月					
					M	B	E	M	B	E	M	B	E	M	B			
1	Works Order Commencement Date	0 days	29/4/2016	29/4/2016														
2	Ping Che Checkpost	67 days	29/4/2016	4/7/2016														
3	Submission and approval of method statement	33 days	29/4/2016	31/5/2016	29/4													
4	Submission of tree survey report	28 days	4/5/2016	31/5/2016	4/5													
5	UU detection	7 days	25/5/2016	31/5/2016		25/5												
6	Asbesto Survey	10 days	22/5/2016	31/5/2016		22/5												
7	Implementation of TTA (Stage 1)	3 days	22/5/2016	24/5/2016		22/5		24/5										
8	Removal of existing mass concrete block	7 days	25/5/2016	31/5/2016		25/5												
9	Demolition of existing check post	7 days	1/6/2016	7/6/2016			1/6											
10	Implementation of TTA (Stage 2)	3 days	8/6/2016	10/6/2016			8/6											
11	Temporary relocation of existing shelter and seats at road side	1 day	11/6/2016	11/6/2016			11/6											
12	Provision of temporary steel decking	2 days	12/6/2016	13/6/2016			12/6											
13	Demolition of existing shelter and associated works	14 days	14/6/2016	27/6/2016			14/6											
14	Road works and Reinstatement	7 days	28/6/2016	4/7/2016														
15	Lin Ma Hang (Cable diversion)	75 days	20/5/2016	2/8/2016														
16	Submission of tree survey report	28 days	22/5/2016	18/6/2016	22/5													
17	Application to CLP	30 days	20/5/2016	18/6/2016	20/5													
18	Construction of pillar box and cable ducts	23 days	19/6/2016	11/7/2016			19/6											
19	Electrical installation	22 days	12/7/2016	2/8/2016														
20	Lin Ma Hang (Phase 1)	7 days	1/8/2016	7/8/2016														
21	Demolition of existing fence, light post and associated works	4 days	3/8/2016	6/8/2016														
22	Reinstatement	1 day	7/8/2016	7/8/2016														
23	Lin Ma Hang (Phase 2)	7 days	8/8/2016	14/8/2016														
24	Demolition of existing fence, light post and associated works	4 days	8/8/2016	11/8/2016														
25	Reinstatement	1 day	12/8/2016	12/8/2016														
26	Lin Ma Hang (Phase 3)	5 days	15/8/2016	19/8/2016														
27	Demolition of existing fence, light post and associated works	4 days	15/8/2016	18/8/2016														
28	Reinstatement	1 day	19/8/2016	19/8/2016														
29	Lin Ma Hang (Phase 4)	7 days	3/8/2016	9/8/2016														
30	Provision of temporary steel decking and setting up of TTA	2 days	3/8/2016	4/8/2016														
31	Demolition of existing fence, light post and associated works	4 days	5/8/2016	8/8/2016														
32	Reinstatement	1 day	9/8/2016	9/8/2016														

Project: Works Programme_Rev2
Date: 24/5/2016


Task Critical Task Milestone Summary

識別碼	Activity Description	Duration	Start	Finish	2016年5月				2016年7月				2016年9月				
					M	B	E	M	B	E	M	B	E	M	B		
33	Lin Ma Hang (Phase 5)	7 days	10/8/2016	16/8/2016													
34	Provision of temporary steel decking and setting up of TTA	2 days	10/8/2016	11/8/2016							10/8	11/8					
35	Demolition of existing fence, light post and associated works	4 days	12/8/2016	15/8/2016							12/8	15/8					
36	Reinstatement	1 day	16/8/2016	16/8/2016							16/8	16/8					
37	Lin Ma Hang (Phase 6)	7 days	17/8/2016	23/8/2016													
38	Provision of temporary steel decking and setting up of TTA	2 days	17/8/2016	18/8/2016							17/8	18/8					
39	Demolition of existing fence, light post and associated works	4 days	19/8/2016	22/8/2016							19/8	22/8					
40	Reinstatement	1 day	23/8/2016	23/8/2016							23/8	23/8					
41	Lin Ma Hang (Phase 7)	7 days	24/8/2016	30/8/2016													
42	Provision of temporary steel decking and setting up of TTA	2 days	24/8/2016	25/8/2016							24/8	25/8					
43	Demolition of existing fence, light post and associated works	4 days	26/8/2016	29/8/2016							26/8	29/8					
44	Reinstatement	1 day	30/8/2016	30/8/2016							30/8	30/8					
45	Lin Ma Hang (Phase 8)	7 days	31/8/2016	6/9/2016													
46	Provision of temporary steel decking and setting up of TTA	2 days	31/8/2016	1/9/2016							31/8	1/9					
47	Demolition of existing fence, light post and associated works	4 days	2/9/2016	5/9/2016							2/9	5/9					
48	Reinstatement	1 day	6/9/2016	6/9/2016							6/9	6/9					
49	Lin Ma Hang (Phase 9)	7 days	7/9/2016	13/9/2016													
50	Provision of temporary steel decking and setting up of TTA	2 days	7/9/2016	8/9/2016							7/9	8/9					
51	Demolition of existing fence, light post and associated works	4 days	9/9/2016	12/9/2016							9/9	12/9					
52	Reinstatement	1 day	13/9/2016	13/9/2016							13/9	13/9					
53	Lin Ma Hang (Phase 10)	7 days	14/9/2016	20/9/2016													
54	Provision of temporary steel decking and setting up of TTA	2 days	14/9/2016	15/9/2016							14/9	15/9					
55	Demolition of existing fence, light post and associated works	4 days	16/9/2016	19/9/2016							16/9	19/9					
56	Reinstatement	1 day	20/9/2016	20/9/2016							20/9	20/9					
57	Lin Ma Hang (Phase 11)	7 days	21/9/2016	27/9/2016													
58	Provision of temporary steel decking and setting up of TTA	2 days	21/9/2016	22/9/2016							21/9	22/9					
59	Demolition of existing fence, light post and associated works	4 days	23/9/2016	26/9/2016							23/9	26/9					
60	Reinstatement	1 day	27/9/2016	27/9/2016							27/9	27/9					
61	Lin Ma Hang (Phase 12)	7 days	28/9/2016	4/10/2016													
62	Provision of temporary steel decking and setting up of TTA	2 days	28/9/2016	29/9/2016							28/9	29/9					
63	Demolition of existing fence, light post and associated works	4 days	30/9/2016	3/10/2016							30/9	3/10					
64	Reinstatement	1 day	4/10/2016	4/10/2016							4/10	4/10					
65	Lin Ma Hang (Phase 13)	7 days	5/10/2016	11/10/2016													


Project: Works Programme_Rev2
Date: 24/5/2016

Task  Critical Task  Milestone  Summary 

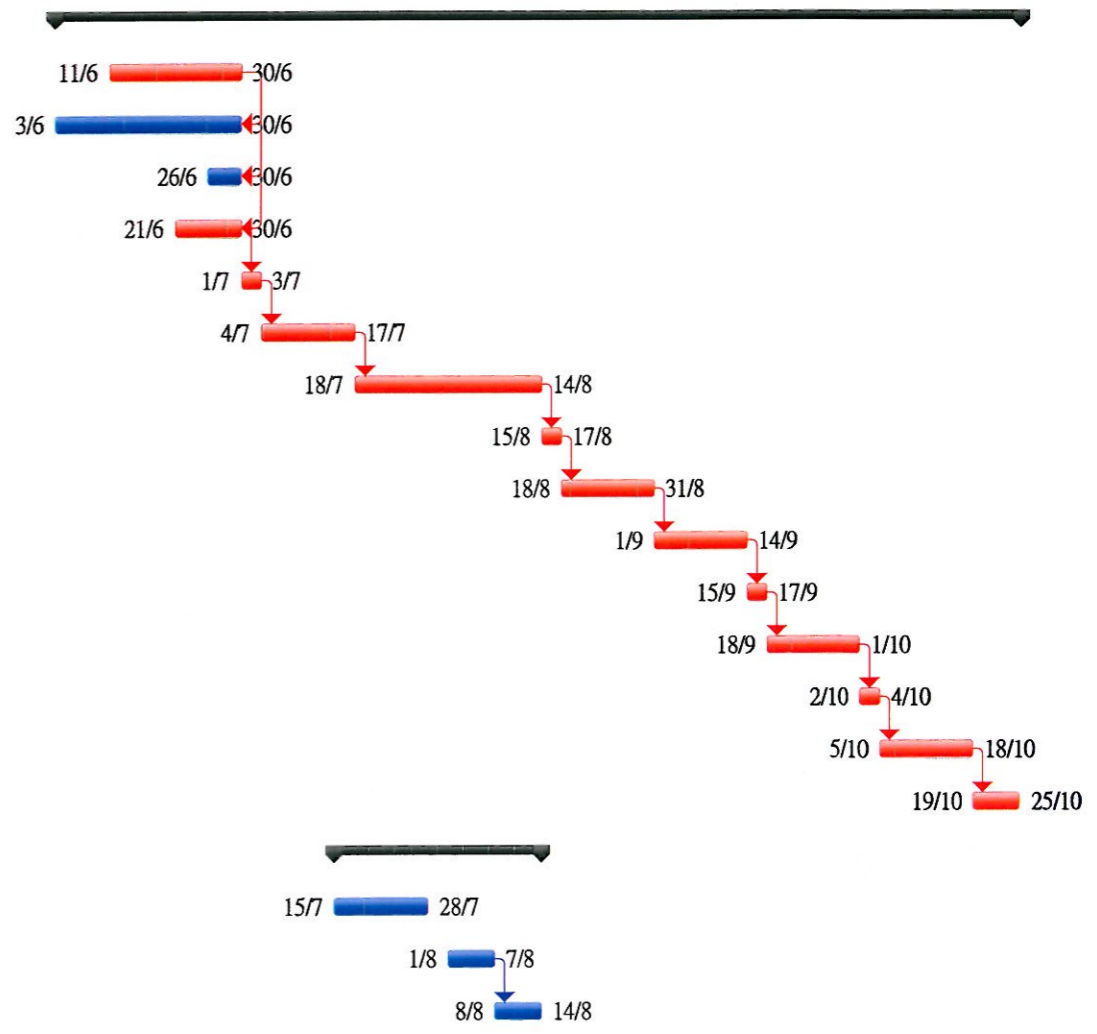

識別碼	Activity Description	Duration	Start	Finish	2016年5月				2016年7月				2016年9月					
					M	B	E	M	B	E	M	B	E	M	B			
66	Provision of temporary steel decking and setting up of TTA	2 days	5/10/2016	6/10/2016										5/10	6/10			
67	Demolition of existing fence, light post and associated works	4 days	7/10/2016	10/10/2016										7/10	10/10			
68	Reinstatement	1 day	11/10/2016	11/10/2016										11/10	11/10			
69	Lin Ma Hang (Phase 14)	7 days	12/10/2016	18/10/2016														
70	Provision of temporary steel decking and setting up of TTA	2 days	12/10/2016	13/10/2016										12/10	13/10			
71	Demolition of existing fence, light post and associated works	4 days	14/10/2016	17/10/2016										14/10	17/10			
72	Reinstatement	1 day	18/10/2016	18/10/2016										18/10	18/10			
73	Lin Ma Hang (Phase 15)	8 days	18/10/2016	25/10/2016														
74	Provision of temporary steel decking and setting up of TTA	2 days	19/10/2016	20/10/2016										19/10	20/10			
75	Demolition of existing fence, light post and associated works	4 days	21/10/2016	24/10/2016										21/10	24/10			
76	Demolition of switch room no.4 and associated works	7 days	18/10/2016	24/10/2016										18/10	24/10			
77	Reinstatement	1 day	25/10/2016	25/10/2016										25/10	25/10			
78	Sha Ling Checkpost	145 days	3/6/2016	25/10/2016														
79	Submission and approval of method statement	20 days	11/6/2016	30/6/2016														
80	Submission of tree survey report	28 days	3/6/2016	30/6/2016														
81	UU detection	5 days	26/6/2016	30/6/2016														
82	Asbesto Survey	10 days	21/6/2016	30/6/2016														
83	Implementation of TTA stage 1	3 days	1/7/2016	3/7/2016														
84	Demolition of existing check post A	14 days	4/7/2016	17/7/2016														
85	Demolition of existing shelter B	28 days	18/7/2016	14/8/2016														
86	Implementation of TTA stage 2	3 days	15/8/2016	17/8/2016														
87	Demolition of existing check post C	14 days	18/8/2016	31/8/2016														
88	Demolition of existing shelter D	14 days	1/9/2016	14/9/2016														
89	Implementation of TTA stage 3A	3 days	15/9/2016	17/9/2016														
90	Demolition of existing shelter E (eastern side)	14 days	18/9/2016	1/10/2016														
91	Implementation of TTA stage 3B	3 days	2/10/2016	4/10/2016														
92	Demolition of existing shelter E (western side)	14 days	5/10/2016	18/10/2016														
93	Road works and Reinstatement	7 days	19/10/2016	25/10/2016														
94	Micellaneous	31 days	15/7/2016	14/8/2016														
95	Demolition of check post 16	14 days	15/7/2016	28/7/2016														
96	Remove existing FCA signage (24 nos.)	7 days	1/8/2016	7/8/2016														
97	Installation of FCA signage (3 nos.)	7 days	8/8/2016	14/8/2016														

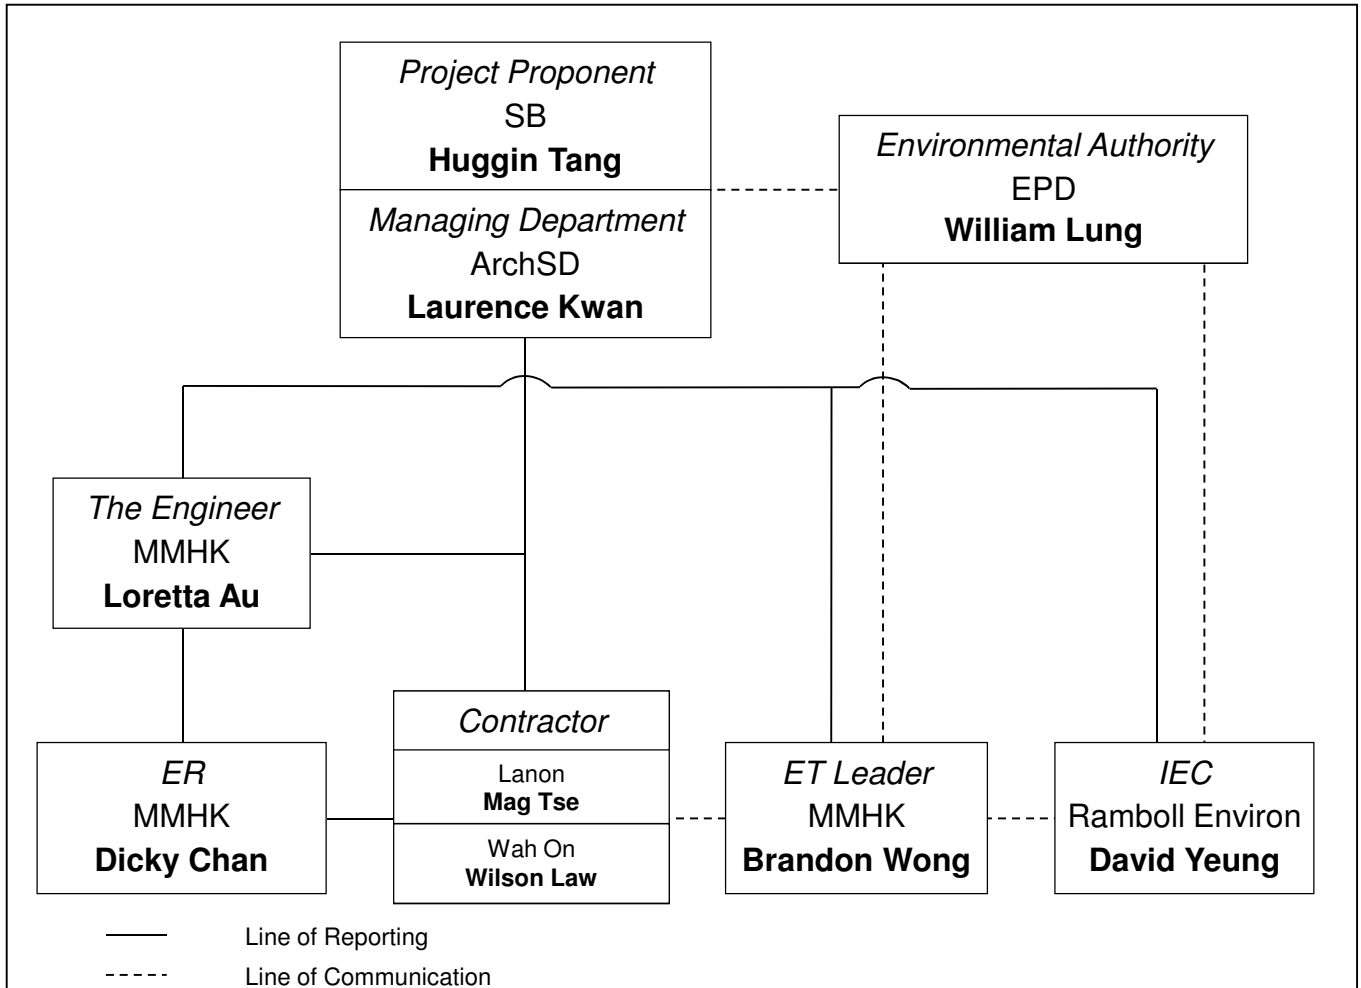

Appendix B. Project Organisation Chart



Key Personnel Contact List			
Role	Department / Company	Name	Telephone No.
Project Proponent	Security Bureau (SB)	Mr. Huggin Tang	2810 3523
Managing Department	Architectural Services Department (ArchSD)	Mr. Laurence Kwan	2867 3871
Environmental Authority	Environmental Protection Department (EPD)	Mr. William Lung	2835 1065
The Engineer	Mott MacDonald Hong Kong Limited (MMHK)	Ms. Loretta Au	2828 5807
Engineer's Representative (ER)	Mott MacDonald Hong Kong Limited (MMHK)	Mr. Dicky Chan	2683 1172
Independent Environmental Checker (IEC)	Ramboll Environ Hong Kong Limited (Ramboll Environ)	Mr. David Yeung	3465 2888
Environmental Team (ET) Leader	Mott MacDonald Hong Kong Limited (MMHK)	Mr. Brandon Wong	2828 5875
The Contractor / Project Manager	Lanon Development Limited (Lanon)	Mr. Mag Tse	9161 4727
The Contractor / Project Manager	Wah On Garden Landscaping Limited (Wah On)	Mr. Wilson Law	9046 6205

 Architectural Services Department	 Mott MacDonald	Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road Phase 2 – Improvement Works for Boundary Fence at Mai Po, Lok Ma Chau and Sha Tau Kok Environmental Permit No. EP-347/2009/A	Title:
			Project Organisation Chart for Phase 2

Appendix C. Environmental Quality Performance Limits

Table C.1: Action and Limit Levels for Construction Noise

Time Period	Action Level	Limit Level
Daytime (07:00-19:00) except general holidays and Sundays <i>Measurements in L_{eq} (30min)</i>	When one documented complaint is received	75 dB(A) For educational institutions
		70 dB(A) (65dB(A) during examinations)

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road



Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016

Appendix D. Event and Action Plans

Table D.1: Event and Action Plan for Construction Noise

EVENT	ACTION			
	ET Leader	IEC	ER	Contractor
Action Level	<ol style="list-style-type: none"> 1. Notify IEC and the Contractor. 2. Carry out investigation. 3. Report the results of investigation to IEC and the Contractor. 4. Discuss with the Contractor and formulate remedial measures. 5. Increase monitoring frequency to check mitigation measures. 	<ol style="list-style-type: none"> 1. Review with analyzed results submitted by ET. 2. Review the proposed remedial measures by the Contractor and advise ER accordingly. 3. Supervise the implement of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analyzed noise problem. 4. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC. 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Identify the source. 2. Notify IEC, ER, EPD and the Contractor. 3. Repeat measurement to confirm findings. 4. Increase monitoring frequency. 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. 6. Inform IEC, ER, and EPD the causes & actions taken for the exceedances. 7. Assess effectiveness of the Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET Leader and the Contractor on the potential remedial actions. 2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise ER accordingly. 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing. 2. Notify the Contractor. 3. Require the Contractor to propose remedial measures for the analyzed noise problem. 4. Ensure remedial measures are properly implemented. 5. If exceedance continues, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance. 2. Submit proposals for remedial actions to IEC within 3 working days of notification. 3. Implement the agreed proposals. 4. Resubmit proposals if problem still not under control. 5. Stop the relevant activity of works as determined by the ER until the exceedance is abated.

Appendix E. Schedule of Mitigation Measures from the EIA Report and EM&A Manual

Table E.1: Recommended Mitigation Measures – Air Quality

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
2.5.2	3.2.2	<p>The following good site practice should be implemented:</p> <ul style="list-style-type: none"> ■ any excavated dusty materials or stockpile of dusty materials should be covered entirely by impervious sheeting or sprayed with water so as to maintain the entire surface wet, and recovered or backfilled or reinstated within 24 hours of the excavation or unloading; ■ the working area of excavation should be sprayed with water immediately before, during and immediately after the operations so as to maintain the entire surface wet; ■ dusty materials carried by vehicle leaving a construction site should be covered entirely by clean impervious sheeting; ■ the area where vehicle washing takes place and the section of the road between the washing facilities and the exit point should paved with concrete, bituminous materials or hardcores; ■ the portion of road leading only to a construction site that is within 30m of designated vehicle entrance or exit should be kept clear of dusty materials; ■ all dusty materials should be sprayed with water prior to any loading, unloading or transfer; ■ vehicle speed should be limited to 10kph except on completed access roads; ■ every vehicle should be washed to remove any dusty materials from its body and wheels before leaving the construction sites. 	Contractor	C	✓

Legend: (1) C - During Construction
 (2) ✓ - Implemented
 P - Partially Implemented
 X - Not Implemented
 REC - Rectified by Contractor
 (REC) - Partially Rectified by Contractor
 ! - Pending Contractor's Rectification Action
 N/A - Not Applicable

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



Table E.2: Recommended Mitigation Measures – Noise

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
3.8.14	4.8.1	<p>The following good site practical should be implemented:</p> <ul style="list-style-type: none"> ■ The Contractor shall adopt the Code of Practice on Good Management Practice to Prevent Violation of the Noise Control Ordinance (Chapter 400) (for Construction Industry) published by EPD; ■ The Contractor shall observe and comply with the statutory and non-statutory requirements and guidelines; ■ Before commencing any work, the Contractor shall submit to the Engineer Representative for approval the method of working, equipment and noise mitigation measures intended to be used at the site; ■ The Contractor shall devise and execute working methods to minimise the noise impact on the surrounding sensitive uses, and provide experienced personnel with suitable training to ensure that those methods are implemented; ■ Noisy equipment and noisy activities should be located as far away from the Noise Sensitive Receivers (NSRs) as is practical; ■ Unused equipment should be turned off. Powered Mechanical Equipment (PME) should be kept to a minimum and the parallel use of noisy equipment / machinery should be avoided; ■ Regular maintenance of all plant and equipment; ■ Material stockpiles and other structures should be effectively utilised as noise barriers, where practicable. 	Contractor	C	✓
3.8.1 - 3.8.3	4.8.2 - 4.8.3	<p>Other than good site practice, the Contractor is required to adopt Levels 1 and 2 site-specific direct mitigation measures as specified below during the construction phase.</p> <p>With construction / demolition work undertaken at a distance of 60m or less to the NSRs, below mitigation measures should be included:</p> <p>Level 1 – Use of Quiet Plant and Movable Noise Barrier</p> <ul style="list-style-type: none"> ■ The Contractor shall obtain particular models of plant that are quieter than standards given in the Technical Memorandum on Noise from Construction Work other than Percussive Piling (GW-TM). ■ Purpose-built movable noise barriers should be used to mitigate construction noise directly at sources that are not usually mobile provide that the direct line of sight to the source is blocked. 	Contractor	C	REC
3.8.9	4.8.4	<p>In addition to the use of quiet plant and movable noise barrier, alternative demolition method of existing boundary fence at Section 2-3 shall be used where demolition works would be undertaken at a distance of 12m or less to the NSRs. These particular mitigation measures should be included:</p> <p>Level 2 – Alternative Demolition Method of Existing Boundary Fence</p> <ul style="list-style-type: none"> ■ The use of welder is recommended to replace the use of hand-held driller; ■ The use of hand-held breaker with movable noise barrier is recommended to replace the use of mini-robot mounted breaker; and the duration for the use of hand-held breaker is minimal as only the surface level of the footing to be broken; and ■ The removal of the footing of the existing boundary fence should be carried by concrete crusher mini-robot mounted after the surface level broken by hand-held breaker. 	Contractor	C	N/A
<p>Legend: (1) C - During Construction (2) ✓ - Implemented (REC) - Partially Rectified by Contractor P - Partially Implemented ! - Pending Contractor's Rectification Action X - Not Implemented N/A - Not Applicable REC - Rectified by Contractor</p>					

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



Table E.3: Recommended Mitigation Measures – Water Quality

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
4.7.1	5.3.1	<p>Good site practices in addition to the implementation of mitigation measures would minimize the impact to the surrounding environment.</p> <p><i>General Prevention and Precaution Measures:</i></p> <ul style="list-style-type: none"> ■ The site should be confined to avoid silt runoff to the site. ■ No discharge of silty water into the storm drain and drainage channel within and the vicinity of the site. ■ Any soil contaminated with chemicals/oils shall be removed from site and the void created shall be filled with suitable materials. ■ Stockpiles to be covered by tarpaulin to avoid spreading of materials during rainstorms; ■ Suitable containers shall be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport; ■ Chemical waste containers shall be labelled with appropriate warning signs in English and Chinese to avoid accidents. there shall also be clear instructions showing what action to take in the event of an accidental; ■ Storage areas shall be selected at safe locations on site and adequate space shall be allocated to the storage area; ■ Any construction plant which causes pollution to the water system due to leakage of oil or fuel shall be removed off-site immediately; ■ Spillage or leakage of chemical waste to be controlled by using suitable absorbent materials; ■ Chemicals will always be stored on drip trays or in bunded areas where the volume is 110% of the stored volume; ■ Regular clearance of domestic waste generated in the temporary sanitary facilities to avoid waste water spillage. ■ Temporary sanitary facilities to be provided for on-site workers during construction. 	Contractor	C	✓
4.7.2 - 4.7.3	5.3.2 - 5.3.3	<p>Concreting Work</p> <p>A temporary drainage channel and associated facilities should be provided to collect the runoff generated and prevent concrete-contaminated water from entering watercourses. Adjustment of pH can be achieved by adding a suitable neutralising reagent to wastewater prior to discharge.</p> <p>The concreting works should be temporarily isolated with proper methods, such as by placing of sandbags or silt curtains with lead edge at bottom and properly supported props.</p>	Contractor	C	N/A
4.7.4	5.3.4	<p>Soil Excavation and Stockpiling</p> <p>Excavated soil which needs to be temporarily stockpiled should be stored in a specially designated area and provided with a tarpaulin cover to avoid runoff into the drainage channels.</p>	Contractor	C	4

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016



EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
4.7.5 - 4.7.6	5.3.5 - 5.3.6	<p>Site Depot</p> <p>All compounds in works areas should be located on areas of hard standing with provision of drainage channels and settlement ponds where necessary to allow interception and controlled release of settled/treated water. Hard standing compounds should drain via an oil interceptor. The oil interceptor should be regularly inspected and cleaned to avoid wash-out of oil during storm conditions. A bypass should be provided to avoid overload of the interceptor's capacity. Any contractor generating waste oil or other chemicals as a result of his activities should register as a chemical waste producer. Disposal of the waste oil should be done by a licensed collector.</p> <p>Good housekeeping practices should be implemented to minimise careless spillage and to keep the storage and the work space in a tidy and clean condition. Appropriate training including safety codes and relevant manuals should be given to the personnel who regularly handle the chemicals on site.</p>	Contractor	C	N/A
4.7.7	5.3.7	<p>Construction of Checkpoint</p> <p>Sewage system should be constructed to divert domestic sewage, which will be generated from the sanitary facilities provided in the new checkpoint at Sha Tau Kok, to public sewer connected to government sewage treatment facilities.</p>	Contractor	C	N/A

- Legend: (1) C - During Construction
- (2) ✓ - Implemented
P - Partially Implemented
X - Not Implemented
REC - Rectified by Contractor
(REC) - Partially Rectified by Contractor
! - Pending Contractor's Rectification Action
N/A - Not Applicable

Table E.4: Recommended Mitigation Measures – Waste Management

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
5.6.7	6.3.6	<p>Site Clearance</p> <p>The topsoil and vegetation removed and excavated material may have to be temporarily stockpiled on-site. Control measures should be taken at the stockpiling area to prevent the generation of dust and pollution of stormwater channels, fish ponds or river channels. However, to eliminate the risk of blocking drains in the wet season, it is recommended that stockpiling of excavated materials during the wet season should be avoided as far as practicable.</p>	Contractor	C	N/A
5.6.10 - 5.6.12	6.3.8	<p>Construction and Demolition Materials</p> <p>Careful design, planning and good site management can minimize over-ordering and generation of waste materials such as concrete mortars and cement grouts. The design of formwork should maximize the use of standard wooden panels so to achieve high reuse levels. Alternatives such as steel formwork or plastic facing should be considered to increase the potential for reuse.</p> <p>The Contractor should recycle as much of the C&D materials as possible on-site. Proper segregation of waste on-site will increase the feasibility of certain components of the waste stream by the recycling contractors. Different areas of the worksite shall be designated for such segregation and storage wherever site conditions permit.</p> <p>Trip-ticket system should be employed to monitor the disposal of C&D material and solid at public filling facilities and landfills, and to control fly-tipping. Government has established a differentiated charging scheme for the disposal of waste to landfill, construction waste sorting facilities and public fill facilities. This will provide additional incentives to reduce the volume of waste generated and to ensure proper segregation of wastes.</p>	Contractor	C	✓
5.6.13 - 5.6.14	6.3.9 - 6.3.13	<p>Chemical Waste</p> <p>For those processes which generate chemical waste, it may be possible to find alternatives which generate reduced quantities or even no chemical waste, or less dangerous types of chemical waste. Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handed in accordance with the Code of Practice on the Packaging, Handling and Storage of Chemical Waste as follows:</p> <p>Containers used for the storage of chemical wastes should:</p> <ul style="list-style-type: none"> ■ be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; ■ have a capacity of less than 450 litres unless the specification have been approved by the EPD; and ■ display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Regulations, <p>The storage area for chemical wastes should:</p> <ul style="list-style-type: none"> ■ be clearly labelled and used solely for the storage of chemical waste; ■ be enclosed on at least 3 sides; ■ have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area 	Contractor	PL	N/A

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
		<p>whichever is the greatest;</p> <ul style="list-style-type: none"> ■ have adequate ventilation; ■ be covered to prevent rainfall entering (water collected within the bund must be tested and disposed as chemical waste if necessary); and ■ be arranged so that incompatible materials are adequately separated. <p>Disposal of chemical waste should:</p> <ul style="list-style-type: none"> ■ be via a licensed waste collector; and ■ be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility which also offers a chemical waste collection service and can supply the necessary storage containers, or ■ to be re-user of the waste, under approval from the EPD. 			
5.6.16	6.3.15	<p>General Refuse</p> <p>Should be stored in enclosed bins or compaction units separate from C&D and chemical wastes. The Contractor should employ a reputable waste collector to remove general refuse from the site, separate from C&D and chemical wastes, on a regular basis to minimise odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law.</p>	Contractor	C	✓
5.6.18	6.3.16	<p>Construction Waste Management Plan</p> <p>A construction waste management plan (CWMP) should be prepared and developed by the contractor to ensure proper collection, treatment and disposal of waste on site. This CWMP will also take into account the requirement to handle chemical wastes on site which will need to be managed by a licensed waste collection contractor.</p>	Contractor	C	✓

- Legend: (1) C - During Construction
PL - During Construction Planning
- (2) ✓ - Implemented
P - Partially Implemented
X - Not Implemented
REC - Rectified by Contractor
(REC) - Partially Rectified by Contractor
! - Pending Contractor's Rectification Action
N/A - Not Applicable

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016



Table E.5: Recommended Mitigation Measures – Ecology

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
Table 6.38	7.2	Ecological Impacts on Floral Species of Conservation Concern <ul style="list-style-type: none"> Erection of protective fencing to protect the plant during construction period 	Contractor	C	✓
Table 6.40	7.2	Potential Ecological Impacts on Offsite Habitats <ul style="list-style-type: none"> Good site practices for controlling the dust and water quality (avoid stockpiles adjacent to wetlands, covering the stockpiles with impervious sheeting, control of vehicle speed, no discharge of silty water to the rivers, streams and drainage channels); Clear definition of works limit to avoid impact on adjacent habitats. 	Contractor	C	✓
Table 6.39 - Table 6.45	7.2	Disturbance to Wetland-Dependent Birds, Raptors, Terrestrial Birds and Egretty <ul style="list-style-type: none"> Good working practices include switching off unused equipment, keep minimum number of powered mechanical equipment in operation at the same period, the use of stockpiles and other structures to form noise barriers where practicable, avoidance of feeding the wildlife to cause disturbance, site confinement and proper cover of stockpiles with impervious sheeting to minimize construction noise, uncontrolled surface runoff and discharge of silts; Avoidance of construction works using Power Mechanical Equipments within the Wetland Conservation Area during bird migratory season (15th November – 15th March); and Restriction of excavation works within a 150m buffer zone from the egretty to ardeid non-breeding season (from August to February). 	Contractor	C	✓

- Legend: (1) C - During Construction
(2) ✓ - Implemented
P - Partially Implemented
X - Not Implemented
REC - Rectified by Contractor
(REC) - Partially Rectified by Contractor
! - Pending Contractor's Rectification Action
N/A - Not Applicable

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road



Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016

Table E.6: Recommended Mitigation Measures – Landscape and Visual

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
Preservation of Existing Vegetation					
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> To retain trees that have high amenity or ecology value and contribute most to the landscape and visual amenity of the site and its immediate environs. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> Creation of precautionary area around trees to be retained equal to half of the trees canopy diameter. Precautionary area to be fenced. 	Project Landscape Architect / Contractor	BC	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> Prohibition of the storage of materials including fuel, the movement of construction vehicles, and the refuelling and washing of equipment including concrete mixers within the precautionary area. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> Phased segmental root pruning for trees to be retained and transplanted over a suitable period (determined by species and size) prior to lifting or site formation works which affect the existing rootball of trees identified for retention. The extent of the pruning will be based on the size and the species of the tree in each case. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> Pruning of the branches of existing trees identified for transplantation and retention to be based on the principle of crown thinning maintaining their form and amenity value. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> The watering of existing vegetation particularly during periods of excavation when the water table beneath the existing vegetation is lowered. 	Project Landscape Architect / Contractor	C1	N/A
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> The rectification and repair of damaged vegetation following the construction phase to its original condition prior to the commencement of the works or replacement using specimens of the same species, size and form where appropriate to the design intention of the area affected. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> All works affecting the trees identified for retention and transplantation will be carefully monitored. This includes the key stages in the preparation of the trees, the implementation of protection measures and health monitoring through out the construction period. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> Detailed landscape and tree preservation proposals will be submitted to the relevant government departments for approval under the lease conditions and in accordance with ETWB TCW No. 2/2004 and WBTC No. 3/2006. 	Project Landscape Architect / Contractor	C1	✓
Table 7-13 CP1	Table 9-1	<ul style="list-style-type: none"> The tree preservation works should be implemented by approved Landscape Contractors and inspected and approved on site by a qualified Landscape Architect. A tree protection specification would be included within the contract documents. 	Contractor	C1	✓
Preservation of Existing Topsoil					
Table 7-13 CP2	Table 9-1	<ul style="list-style-type: none"> Topsoil disturbed during the construction phase should be tested using a standard soil testing methodology and where it is found to be worthy of retention stored for re-use. 	Contractor	C1	✓

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road



Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016

EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
Table 7-13 CP2	Table 9-1	<ul style="list-style-type: none"> The soil will be stockpiled to a maximum height of 2m and will be either temporarily vegetated with hydroseeded grass during construction or covered with a waterproof covering to prevent erosion. 	Contractor	C1	✓
Table 7-13 CP2	Table 9-1	<ul style="list-style-type: none"> The stockpile should be turned over on a regular basis to avoid acidification and the degradation of the organic material, and reused after completion. Alternatively, if this is not practicable, it should be considered for use elsewhere, including other projects. 	Contractor	C1	✓
Permanent and Temporary Works Areas					
Table 7-13 CP3	Table 9-1	<ul style="list-style-type: none"> Where appropriate to the final design the landscape of these works areas should be restored following the completion of the construction phase. 	Contractor	C1	✓
Table 7-13 CP3	Table 9-1	<ul style="list-style-type: none"> Construction site controls should be enforced including the storage of materials, the location and appearance of site accommodation and the careful design of site lighting to prevent light spillage. 	Contractor	C1	✓
Mitigation Planting					
Table 7-13 CP4	Table 9-1	<ul style="list-style-type: none"> Replanting of disturbed vegetation should be undertaken at the earliest possible stage of the construction phase. 	Contractor	C1	✓
Table 7-13 CP4	Table 9-1	<ul style="list-style-type: none"> Use of native plant species predominantly in the planting design for the buffer areas. 	Contractor	C1	✓
Table 7-13 CP4	Table 9-1	<ul style="list-style-type: none"> The tree planting works should be implemented by approved Landscape Contractors and inspected and approved on site by a qualified Landscape Architect. A tree planting specification would be included within the contract documents. 	Contractor	C1	✓
Transplantation of Existing Trees					
Table 7-13 CP5	Table 9-1	<ul style="list-style-type: none"> The tree transplanting works should be implemented by approved Landscape Contractors and inspected and approved on site by a qualified Landscape Architect. A tree protection / transplanting specification would be included within the contract documents. 	Contractor	BC1	✓
Design of the Fence and associated Structures					
Table 7-14 OP1	Table 9-2	<p>Design of Boundary Fence, Boundary Patrol Road and Police Check Point – These structural elements will be designed in accordance with security requirement from Police Force and incorporate design features as part of design mitigation measures including:</p> <ol style="list-style-type: none"> Integrated design approach – the boundary fence should be integrated, as far as technically feasible, with existing built structures such as existing road, footpath and track and embankment of fishponds, river and drainage channel as part of design mitigation measures to reduce the potential cumulative impact of the proposed works. The location and orientation of the police check points should be away from landscape and visually sensitive areas such as wetland, fishpond and agricultural field. Building massing - the proposed use of simple 	ArchSD	D	✓

216727/307/16/EM&A(2016-06) July 2016

P:\Hong Kong\INF\Projects\216727-Boundary Fence\Environmental\Environmental Team\Phase 2\Deliverable\Monthly EM&A Report\2016-06\EM&A Report (June 2016) Rev A.doc

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road

Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok – Monthly EM&A Report for June 2016



EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
		<p>responsive design for the built structures with a low building height profile to reduce the potential visual mass of the structure within a rural context.</p> <p>3. Treatment of built structures - the architectural design should seek to reduce the apparent visual mass of the facilities further through the use of natural materials such as wooden frame, vertical greening or other sustainable materials such as recycled plastic.</p> <p>4. Responsive building and fence finishes - In terms of the proposed finishes natural tones should be considered for the colour palette with non-reflective finishes are recommended to reduce glare effect. The use of colour blocking on the proposed fence could be used to break up the visual mass of the structure.</p> <p>5. Responsive lighting design – Aesthetic design of architectural and track lighting with following glare design measures:</p> <ul style="list-style-type: none"> – Directional and full cut off lighting is recommended particularly for areas adjacent to existing village to minimise light spillage. – Minimise geographical spread of lighting, only applied for safety and security reasons; – Limited lighting intensity to meet the minimum safety and operation requirement; and – High-pressure sodium road lighting is recommended for more stringent light control reducing spillage and thus visual impacts. 			
Compensatory Planting Proposals					
Table 7-14 OP2	Table 9-2	<ul style="list-style-type: none"> ■ Utilise native to Hong Kong will be utilized within the buffer planting areas. 	Contractor	D	✓
Table 7-14 OP2/3	Table 9-2	<ul style="list-style-type: none"> ■ A qualified or registered landscape architect will be involved in the design, construction supervision and monitoring, and maintenance period to oversee the implementation of the recommended landscape and visual mitigation measures including the tree preservation and landscape works on site. 	Contractor	D	✓
Table 7-14 OP2	Table 9-2	<p>Tree and Shrub Planting – Given the rural nature of the proposed alignment it is recommended that the where possible tree and shrub species which are native to Hong Kong be used. In addition where possible the planting of new trees and shrubs will aim to link together existing woodland areas and small tree groups to improve the connectivity between habitats and create more coherent landscape framework. The planting of small groups of trees along the alignment of the proposed fence will serve to de-emphasise the horizontality of the fence structure and provide for better sense of visual integration with the landscape context. Where practicable vertical greening measures should also be considered on engineering structures.</p>	Contractor	D	✓
Table 7-14 OP2	Table 9-2	<p>Compensatory Planting Proposals – Given the works extent is largely limited along existing roadside embankment to minimise impact to existing village settlements and valuable landscape resources such as wetland, fishpond, stream course and existing trees, and considered the importance of</p>	Contractor	D	✓

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road
Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
Monthly EM&A Report for June 2016





EIA Ref.	EM&A Manual Ref.	Recommended Mitigation Measures	Who to implement?	When to implement? (1)	Implementation Status (2)
		<p>tree retention within the works area, new tree planting will concentrate in selected new amenity areas along the alignment, infilling between retained and transplanted trees. The preliminary planting proposals for the proposed works include the planting of some 357 new trees utilising a combination of mature to light standard sized stock (i.e. approximately 15% of mature trees, 75% of standard trees, and 10% light standard trees). These trees will be planted in woodland clumps and small tree groups at strategic locations to de-emphasise the horizontality of the fence alignment. Based on preliminary findings the proposed planting will result in a compensatory planting ratio of 1:1 (new planting: trees recommended for felling). This compares favourably with the report's assertion that some 357 trees would be felled due to the proposed works. With the proposed preservation of existing trees, transplantation of trees in conflict with the proposals and the planting of new trees the project area will contain approximately 2000 trees. Trees forming part of the new planting will provide screening to neighbourhood villagers and will utilise species native to Hong Kong. These proposals will be subject to review at detailed design stage of the project.</p>			

- Legend: (1) C1 - Throughout Construction Phase
 BC - Before Construction Phase Commences
 BC1 - Prior to the Commencement of the Proposed Works
 D - Throughout Design Phase
- (2) ✓ - Implemented
 P - Partially Implemented
 X - Not Implemented
 REC - Rectified by Contractor
 (REC) - Partially Rectified by Contractor
 ! - Pending Contractor's Rectification Action
 N/A - Not Applicable

Appendix F. EM&A Schedule

Environmental Monitoring and Audit Schedule for June 2016

Sun	Mon	Tue	Wed	Thu	Fri	Sat
			1	2	3 **	4
5	6	7	8	9 Tuen Ng Festival	10 *	11
12	13	14	15	16	17 *	18
19	20	21	22	23	24 *	25
26	27	28	29	30 *		

-  Noise Monitoring
- * Site Audit by Environmental Team (ET) for all subject works
- ** Site Audit with Independent Environmental Checker (IEC) for all subject works
-  Public Holiday

Construction of a Secondary Boundary Fence and New Sections of Primary Boundary Fence and Boundary Patrol Road
 Improvement Works for Mai Po, Lok Ma Chau, Sha Tau Kok, Planting Works at Tak Yuet Lau and Demolition Work at Shek Chung Au, Lo Wu to Sha Tau Kok –
 Monthly EM&A Report for June 2016



Tentative Environmental Monitoring and Audit Schedule for July 2016

Sun	Mon	Tue	Wed	Thu	Fri	Sat
					1	2
					HKSAR Establishment Day	
3	4	5	6	7	8 **	9
10	11	12	13	14	15 *	16
17	18	19	20	21	22 *	23
24	25	26	27	28	29 *	30
31						

* Site Audit by Environmental Team (ET) for all subject works

** Site Audit with Independent Environmental Checker (IEC) for all subject works

Public Holiday

Appendix G. Calibration Certificates



Calibration Certificate

Certificate No. **604025**

Page 1 of 2 Pages

Customer : Mott MacDonald Hong Kong Limited

Address : 20/F, Two Landmark East, 100 How Ming Street, Kwun Tong, Kowloon, Hong Kong.

Order No. : Q61489

Date of receipt : 16-May-16

Item Tested

Description : Acoustic Calibrator

Manufacturer : Castle

I.D. : --

Model : GA607

Serial No. : 040162

Test Conditions

Date of Test : 30-May-16

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : F06, F20, Z02.

Test Results

All results were within the IEC 942 Class 1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No.	Description	Cert. No.	Traceable to
S014	Spectrum Analyzer	505317	NIM-PRC & SCL-HKSAR
S240	Sound Level Calibrator	601604	NIM-PRC & SCL-HKSAR
S041	Universal Counter	506951	SCL-HKSAR
S206	Sound Level Meter	506958	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

Calibrated by : 
Kin Wong

Approved by : 
Steve Kwan

This Certificate is issued by:
Hong Kong Calibration Ltd.
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.
Tel: 2425 8801 Fax: 2425 8646

Date: 30-May-16



Calibration Certificate

Certificate No. 604025

Page 2 of 2 Pages

Results :

1. Level Accuracy

UUT Setting (dB)	Measured Value (dB)	IEC 942 Class 1 Spec.
94.0	94.2	± 0.3 dB

Uncertainty : ± 0.2 dB

2. Frequency Accuracy

UUT Nominal Value (kHz)	Measured Value (kHz)	IEC 942 Class 1 Spec.
1.000	1.0002	± 2 %

Uncertainty : ± 3.6 x 10⁻⁶

3. Level Stability : 0.0 dB

IEC 942 Class 1 Spec.: ± 0.1 dB

Uncertainty : ± 0.01 dB

4. Total Harmonic Distortion : < 0.9 %

IEC 942 Class 1 Spec. : < 3 %

Uncertainty : ± 2.3 % of rdg.

Remark : 1. UUT : Unit-Under-Test

2. The above measured values were the mean of 3 measurements.

3. The uncertainty claimed is for a confidence probability of not less than 95%.

4. Atmospheric Pressure : 1008 hPa.

----- END -----



Calibration Certificate

Certificate No. **604024**

Page 1 of 3 Pages

Customer : Mott MacDonald Hong Kong Limited

Address : 20/F, Two Landmark East, 100 How Ming Street, Kwun Tong, Kowloon, Hong Kong.

Order No. : Q61489

Date of receipt : 16-May-16

Item Tested

Description : Precision Integrating Sound Level Meter

Manufacturer : Rion

I.D. : --

Model : NL-31

Serial No. : 01262786

Test Conditions

Date of Test : 27-May-16

Supply Voltage : --

Ambient Temperature : (23 ± 3)°C

Relative Humidity : (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure : Z01, IEC 651, IEC 804.

Test Results

All results were within the IEC 651 Type 1 & IEC 804 Type 1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S017	Multi-Function Generator	C147450	SCL-HKSAR
S240	Sound Level Calibrator	601604	NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant.
The test results apply to the above Unit-Under-Test only

Calibrated by : 
Kin Wong

Approved by : 
Steve Kwan

Date: 27-May-16

This Certificate is issued by:
Hong Kong Calibration Ltd.
Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.
Tel: 2425 8801 Fax: 2425 8646



Calibration Certificate

Certificate No. 604024

Page 2 of 3 Pages

Results :

1. SPL Accuracy

UUT Setting			Applied Value (dB)	UUT Reading (dB)
Level Range (dB)	Weight	Response		
20 – 100	L _A	Fast	94.0	94.0
		Slow		93.9
	L _C	Fast		94.0
		L _p		Fast
30 – 120	L _A	Fast	94.0	93.9
		Slow		93.9
	L _C	Fast		94.0
	L _p	Fast		94.2
30 – 120	L _A	Fast	114.0	114.0
		Slow		113.9
	L _C	Fast		114.0
	L _p	Fast		114.2

IEC 651 Type 1 Spec. : ± 0.7 dB

Uncertainty : ± 0.1 dB

2. Level Stability : 0.0 dB

IEC 651 Type 1 Spec. : ± 0.3 dB

Uncertainty : ± 0.01 dB

3. Linearity

3.1 Level Linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec. (Primary Indicator Range)
130	114.0	114.0	0.0	± 0.7 dB
130	104.0	104.0	0.0	
120	94.0	94.0 (Ref.)	- -	
110	84.0	84.1	+0.1	
100	74.0	74.1	+0.1	
90	64.0	64.2	+0.2	
80	54.0	54.2	+0.2	

Uncertainty : ± 0.1 dB



Calibration Certificate

Certificate No. 604024

Page 3 of 3 Pages

3.2 Differential level linearity

UUT Range (dB)	Applied Value (dB)	UUT Reading (dB)	Variation (dB)	IEC 651 Type 1 Spec.
120	84.0	84.1	+0.1	± 0.4 dB
	94.0	94.0 (Ref.)	--	
	95.0	95.0	0.0	± 0.2 dB

Uncertainty : ± 0.1 dB

4. Frequency Weighting - A weighting

Frequency	Attenuation (dB)	IEC 651 Type 1 Spec.
31.5 Hz	-39.9	- 39.4 dB, ± 1.5 dB
63 Hz	-26.3	- 26.2 dB, ± 1.5 dB
125 Hz	-16.2	- 16.1 dB, ± 1 dB
250 Hz	-8.6	- 8.6 dB, ± 1 dB
500 Hz	-3.2	- 3.2 dB, ± 1 dB
1 kHz	0.0 (Ref.)	0 dB, ± 1 dB
2 kHz	+1.3	+ 1.2 dB, ± 1 dB
4 kHz	+1.4	+ 1.0 dB, ± 1 dB
8 kHz	+0.3	- 1.1 dB, + 1.5 dB ~ - 3 dB
16 kHz	-4.0	- 6.6 dB, + 3 dB ~ - ∞

Uncertainty : ± 0.1 dB

5. Time Averaging

Applied Burst duty Factor	Applied Leq Value (dB)	UUT Reading (dB)	IEC 804 Type 1 Spec.
continuous	40.0	40.0	--
1/10	40.0	39.9	± 0.5 dB
1/10 ²	40.0	40.0	
1/10 ³	40.0	39.9	
1/10 ⁴	40.0	40.0	± 1.0 dB

Uncertainty : ± 0.1 dB


- Remarks:
1. UUT : Unit-Under-Test
 2. The uncertainty claimed is for a confidence probability of not less than 95%.
 3. Atmospheric Pressure : 1004 hPa
 4. The UUT's internal calibration was performed before the calibration.

----- END -----

Appendix H. Noise Monitoring Results and Graphical Presentation

Daytime Noise Monitoring Results at Station STK-IC HK

Date	Weather Conditions	Wind Speed, m/s	Noise Level for 30-min, dB(A)					Major Construction Noise Sources	Other Noise Sources during monitoring	Remarks
			Start	End	Leq	L10	L90			
03-Jun-16	Sunny	1.7	10:03	10:33	68	72	60	Nil	Road traffic noise, DSD site opposite STK-IC HK (operation of hand-held breaker) (not Project-related)	No demolition or construction work at Project site
10-Jun-16	Sunny	1.4	09:43	10:13	69	72	64	Nil	Road traffic noise, DSD site opposite STK-IC HK (operation of Crane and excavator) (not Project-related)	No demolition or construction work at Project site
17-Jun-16	Sunny	1.4	09:29	09:59	67	71	55	Nil	Road traffic noise (not Project-related)	No demolition or construction work at Project site
					Min.	67				
					Max.	69				

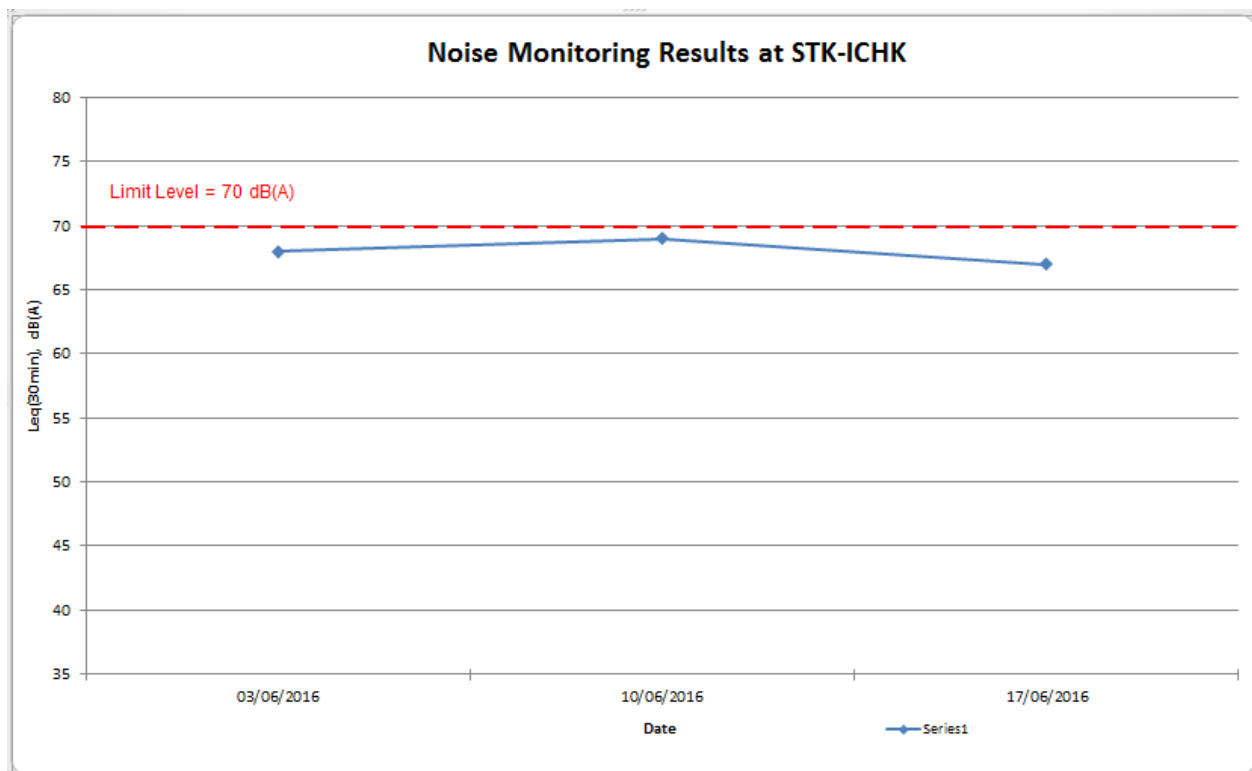

Appendix I. Monthly Waste Flow Table

Table I.1: Monthly Summary Waste Flow Table for Reporting Month (from April 2015)

Month	Actual Quantities of Inert C&D Materials Generated Monthly (in '000 m ³)										Actual Quantities of C&D Wastes Generated Monthly									
	Total Quantity Generated		Broken Concrete		Reused in the Contract		Reused in other Projects		Disposed of at Public Fill		Metals ('000 kg)		Paper/ Cardboard ('000 kg)		Plastics ('000 kg)		Chemical waste ('000 kg)		Others (e.g. refuse) ('000 m ³)	
	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.	Est.	Act.
Jan-15	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Feb-15	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Mar-15	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Apr-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
May-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Jun-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Sub-total	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Jul-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Aug-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Sep-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Oct-15	-	0.0065	-	0	-	0	-	0	-	0.0065	-	0	-	0	-	0	-	0	-	0
Nov-15	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Dec-15	-	0.0189	-	0	-	0	-	0	-	0.0189	-	0	-	0	-	0	-	0	-	0
Sub-total	-	0.0254	-	0	-	0	-	0	-	0.0254	-	0	-	0	-	0	-	0	-	0
Jan-16	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Feb-16	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Mar-16	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Apr-16	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
May-16	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0	-	0
Jun-16	-	0.052	-	0	-	0	-	0	-	0.052	-	0	-	0	-	0	-	0	-	0
Total	-	0.0774	-	0	-	0	-	0	-	0.0774	-	0	-	0	-	0	-	0	-	0

Appendix J. Complaint Log

Table J.1: Complaint Log for the Reporting Month

Log Ref.	Location	Complainant / Date of Contact	Details of Complaint	Investigation / Mitigation Action	File Closed
N/A	N/A	N/A	N/A	N/A	N/A




Note: No environmental complaint was received in June 2016.

Appendix K. Weather Information from Hong Kong Observatory

This Appendix presents wind data obtained from the nearest Hong Kong Observatory monitoring station, at Ta Kwu Ling, during noise impact monitoring days.




Wind Data for Ta Kwu Ling

3 Jun 2016

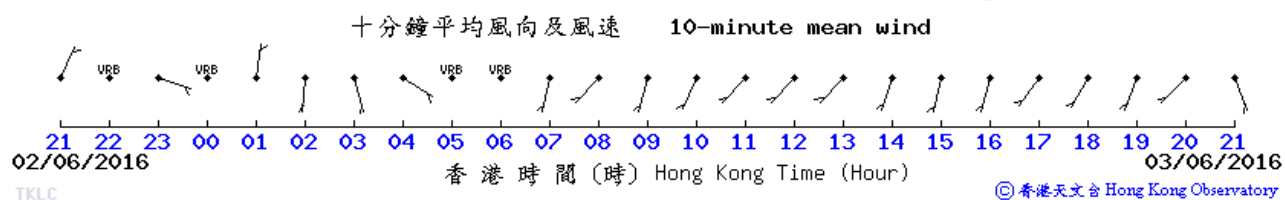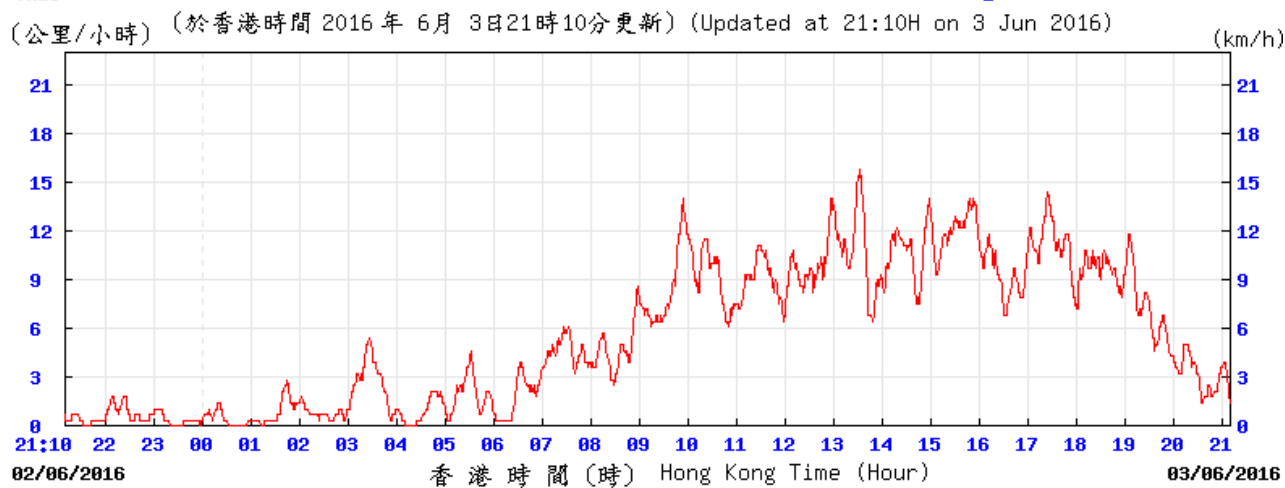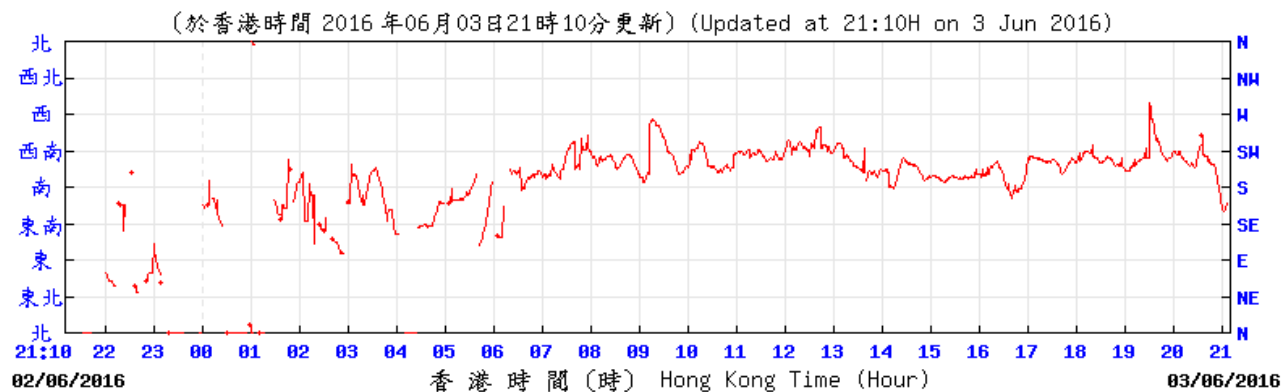

Wind Data for Ta Kwu Ling

4 Jun 2016

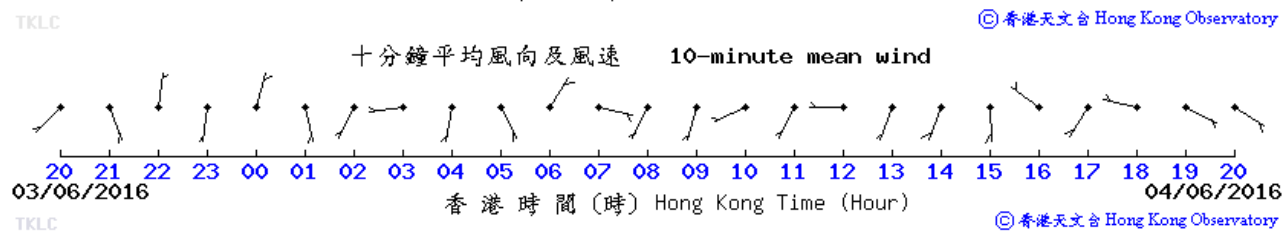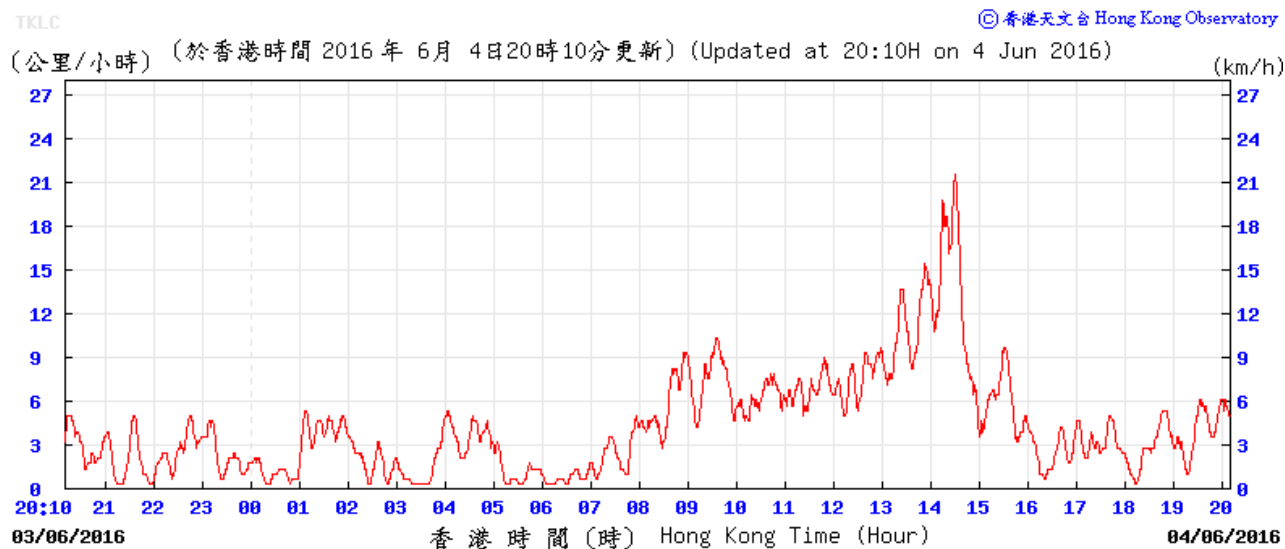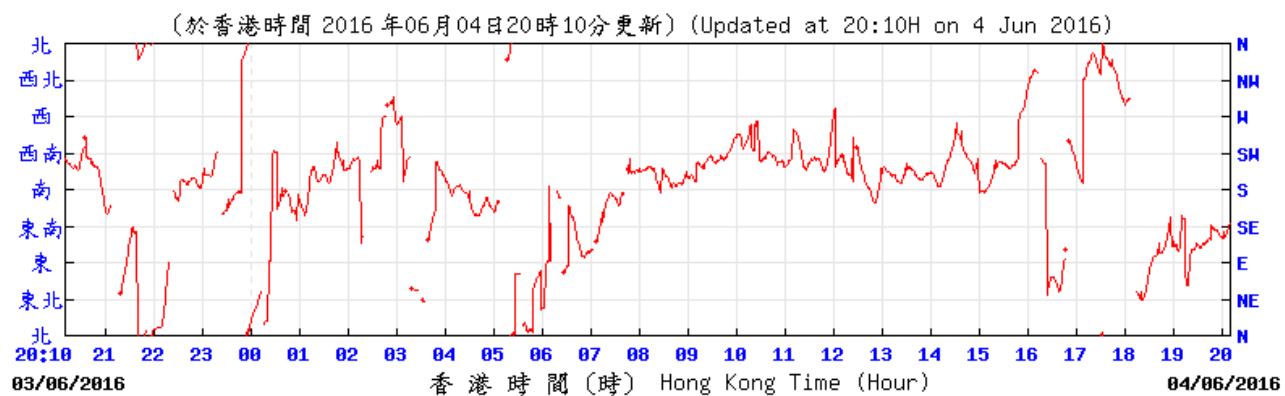




© 香港天文台 Hong Kong Observatory

© 香港天文台 Hong Kong Observatory

© 香港天文台 Hong Kong Observatory




Wind Data for Ta Kwu Ling

10 Jun 2016

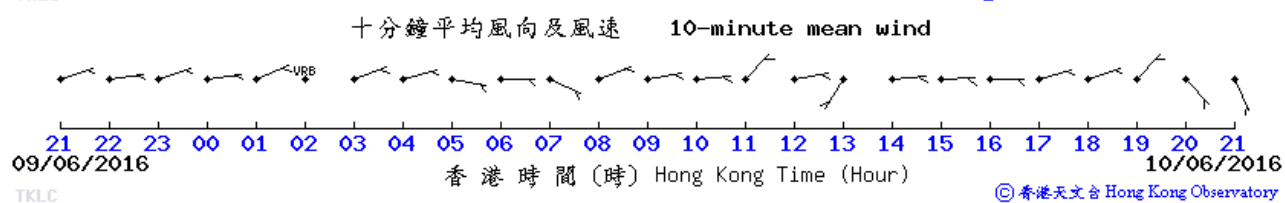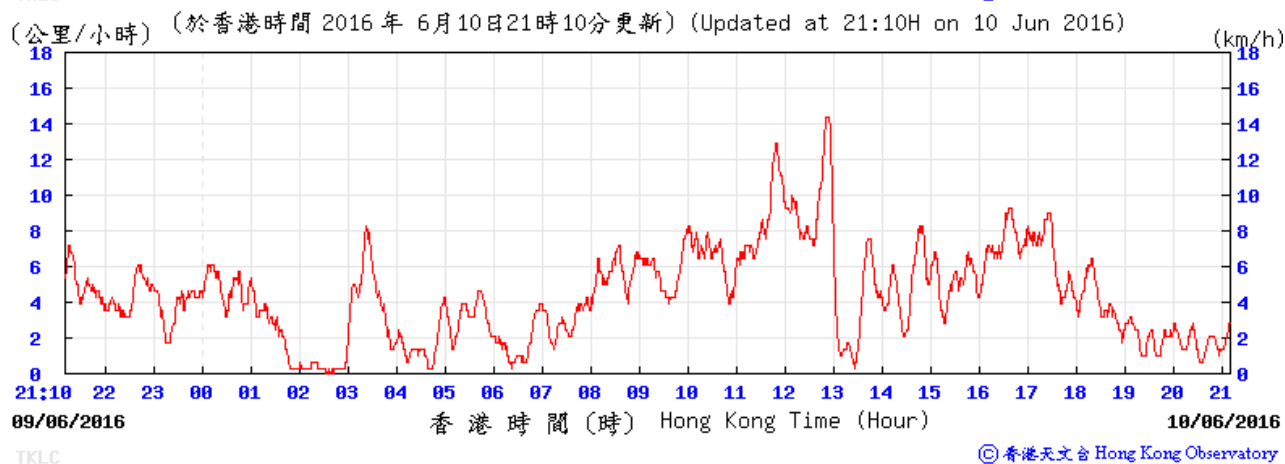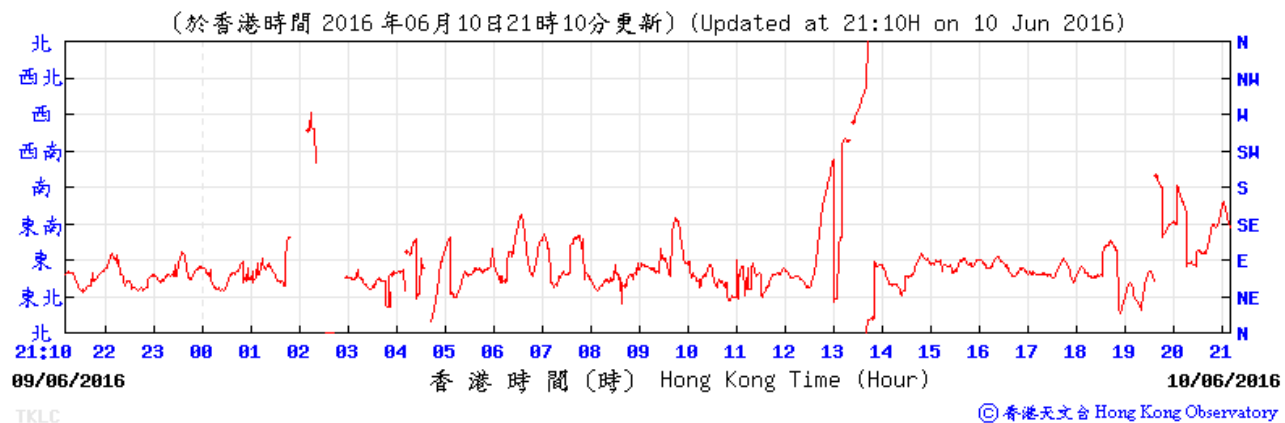

Wind Data for Ta Kwu Ling




11 Jun 2016

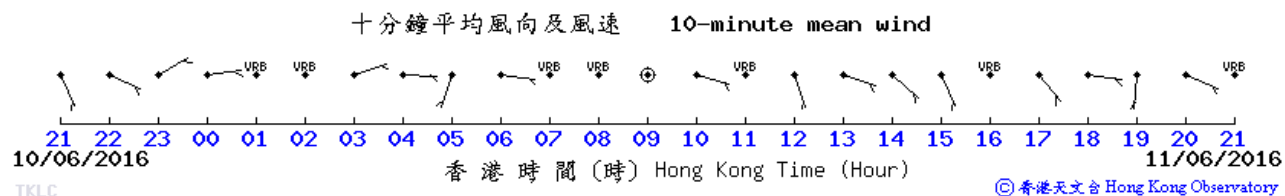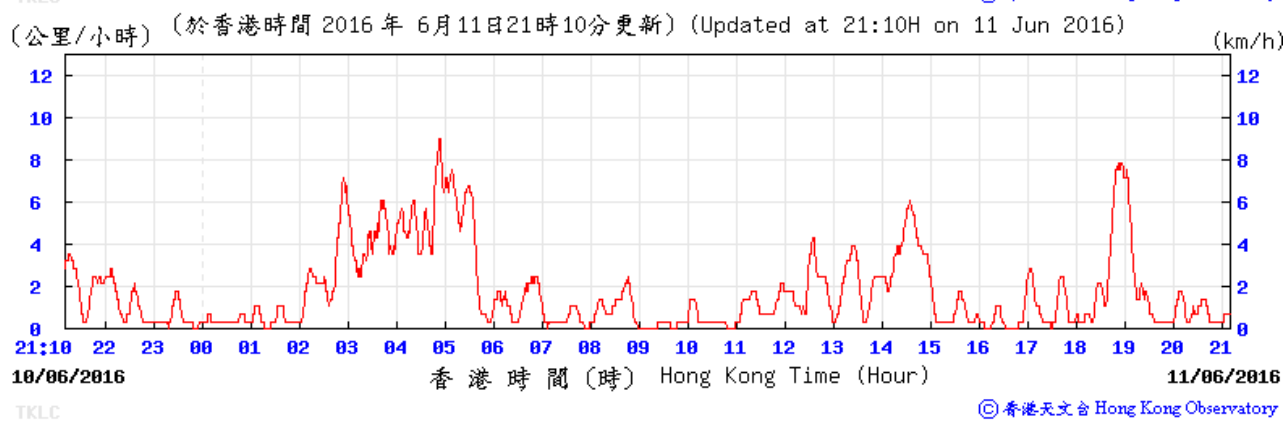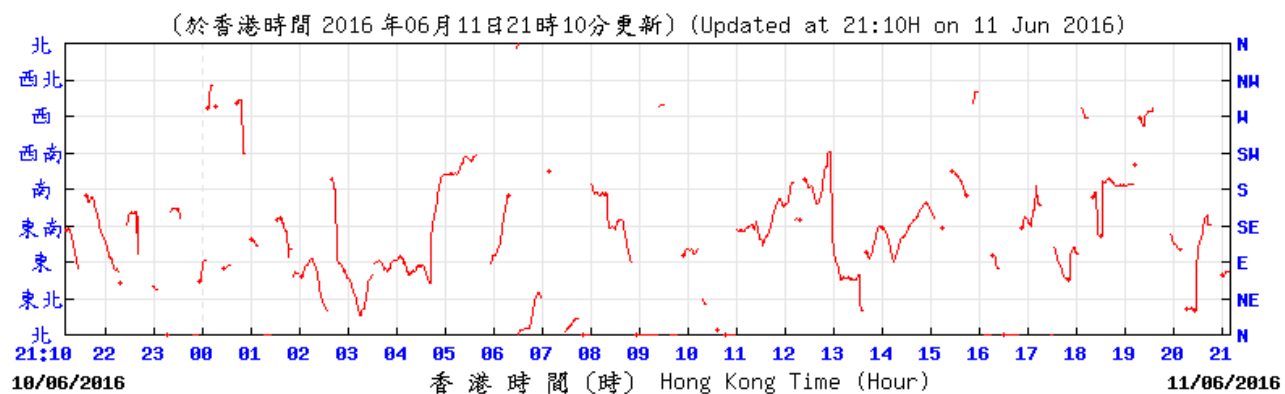

Wind Data for Ta Kwu Ling




17 Jun 2016

(於香港時間 2016 年 06 月 17 日 21 時 10 分更新) (Updated at 21:10H on 17 Jun 2016)

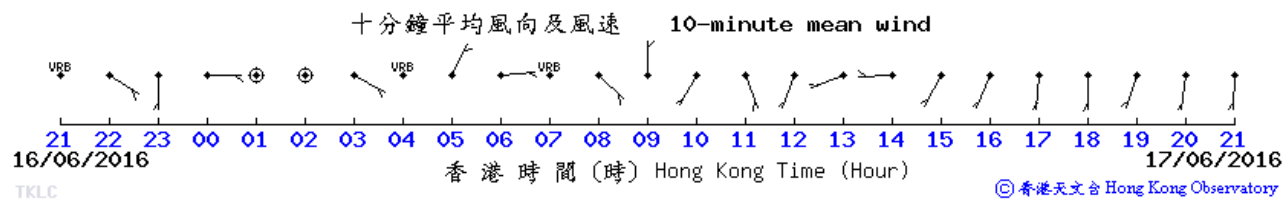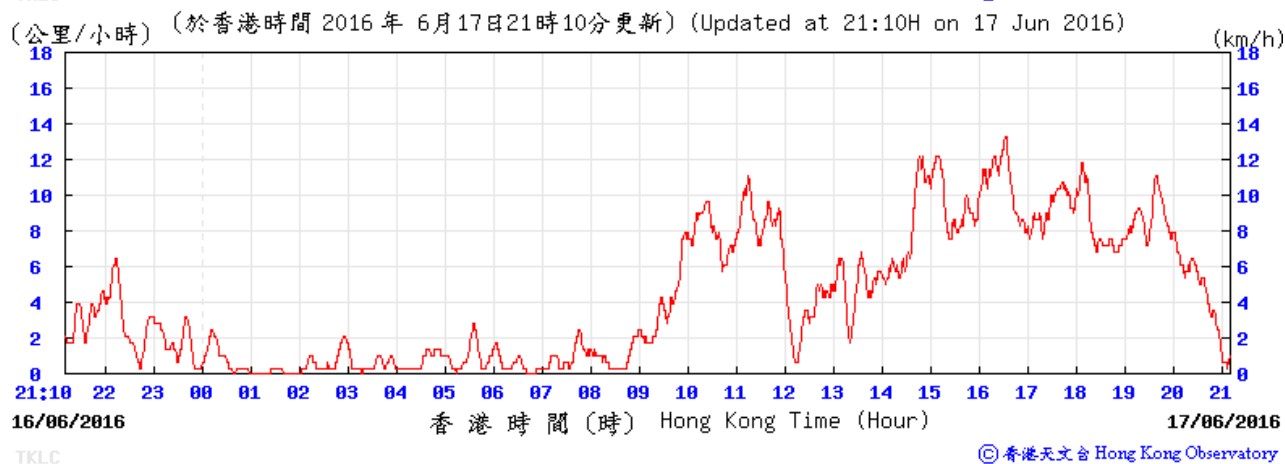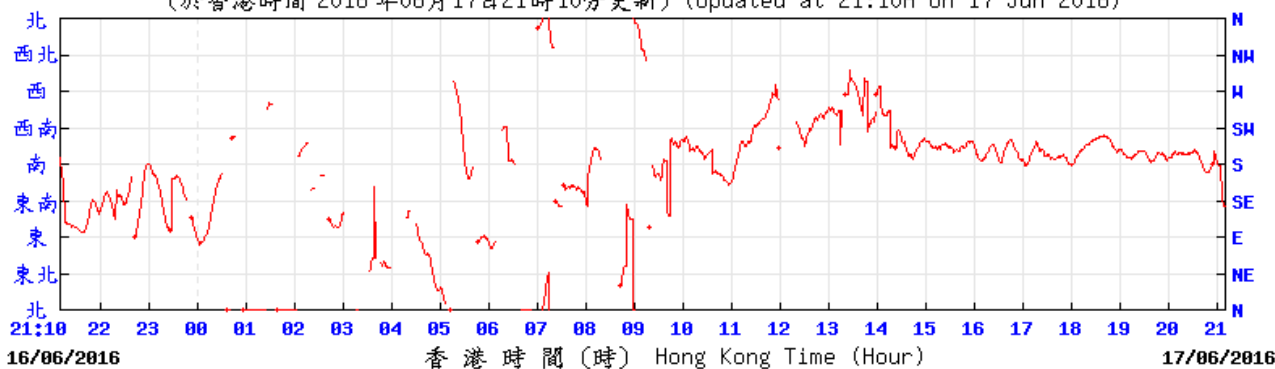

Wind Data for Ta Kwu Ling

18 Jun 2016

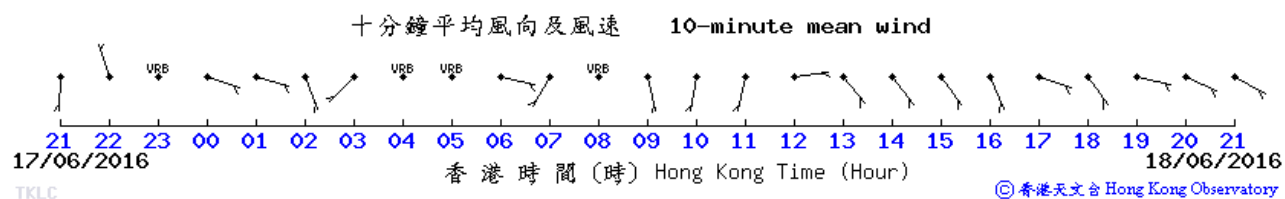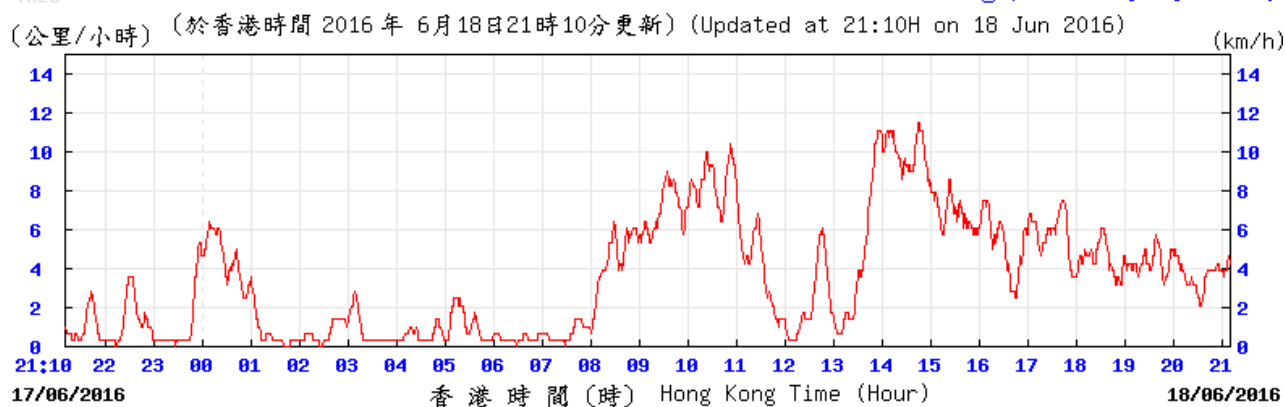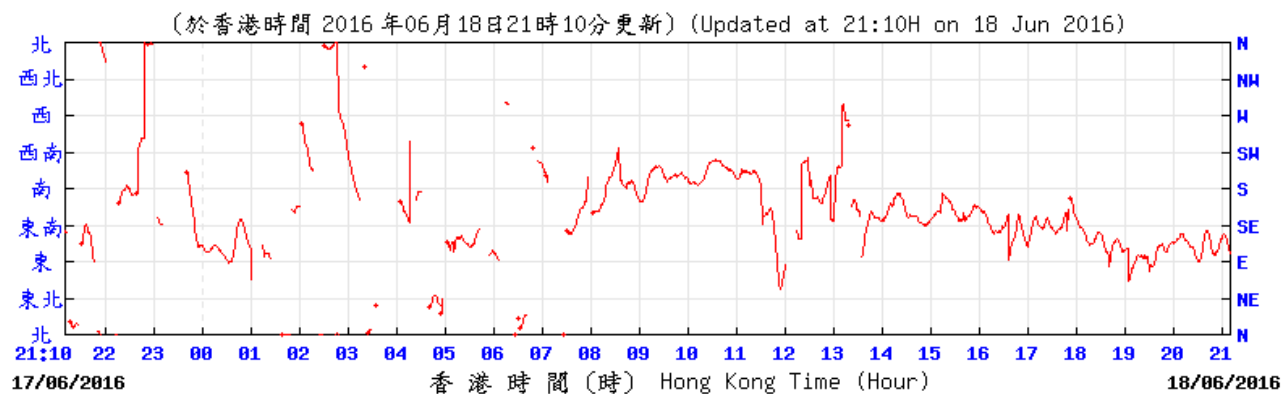

**EXTRACT OF METEOROLOGICAL OBSERVATIONS FOR HONG KONG,
JUNE 2016 (Table 1)**

Date June	Mean Pressure (hPa)	Air Temperature			Mean Dew Point Temperature (deg. C)	Mean Relative Humidity (%)	Mean Amount of Cloud (%)	Total Rainfall (mm)
		Maximum (deg. C)	Mean (deg. C)	Minimum (deg. C)				
1	1007.8	32.8	30.1	28.6	26.2	80	73	-
2	1006.0	33.0	30.3	28.7	26.3	79	58	-
3	1006.5	32.4	30.3	29.0	26.5	80	77	Trace
4	1007.9	33.8	28.7	24.7	25.4	83	75	12.4
5	1008.8	30.4	26.9	25.0	24.3	86	87	7.6
6	1008.8	29.1	26.2	24.8	24.7	91	80	77.6
7	1008.1	30.7	28.1	26.3	25.4	86	75	0.4
8	1006.3	30.0	27.1	24.1	25.1	89	85	46.5
9	1005.7	31.7	28.2	26.6	25.7	86	79	Trace
10	1005.7	31.1	27.9	26.6	25.8	89	80	9.1
11	1005.9	27.8	26.6	25.4	25.4	93	85	85.5
12	1005.7	29.2	27.1	25.4	25.8	93	96	28.2
13	1005.0	31.5	29.7	28.5	26.7	84	90	0.1
14	1004.2	31.7	30.2	29.2	26.6	81	88	Trace
15	1005.3	32.0	30.3	29.3	26.3	79	86	0.6
16	1006.7	31.4	29.4	28.2	25.9	82	88	2.8
17	1008.2	32.1	29.4	26.7	25.9	82	85	2.5
18	1010.5	30.8	29.3	27.7	26.0	83	81	13.1
19	1010.3	34.2	30.1	27.8	26.1	80	41	-
20	1008.5	34.4	30.8	28.6	26.3	78	59	Trace
21	1009.3	33.7	30.6	28.7	25.6	75	51	-
22	1009.5	33.7	30.5	28.5	25.3	75	32	-
23	1008.4	34.1	30.4	28.4	24.7	72	20	-
24	1008.1	35.2	31.0	28.8	25.0	72	38	-
25	1008.9	35.5	31.4	28.9	26.1	74	39	-
26	1009.1	35.1	31.3	29.4	26.3	75	57	Trace
27	1007.5	35.1	31.1	28.6	26.7	78	61	1.7
28	1007.5	32.3	29.1	26.3	26.3	85	83	37.1
29	1010.0	33.3	29.0	27.5	26.7	87	79	20.4
30	1010.3	33.1	30.0	27.8	26.0	80	83	1.8
Mean/Total	1007.7	32.4	29.4	27.5	25.8	82	70	347.4
Normal*	1006.1	30.2	27.9	26.2	24.6	82	77	456.1
Station	Hong Kong Observatory							

**EXTRACT OF METEOROLOGICAL OBSERVATIONS FOR HONG KONG,
JUNE 2016 (Table 2)**

Date June	Number of hours of Reduced Visibility [#] (hours)	Total Bright Sunshine (hours)	Daily Global Solar Radiation (MJ/m ²)	Total Evaporation (mm)	Prevailing Wind Direction (degrees)	Mean Wind Speed (km/h)
1	1	7.2	22.64	5.1	230	31.7
2	0	10.0	26.77	7.1	230	27.4
3	0	5.2	18.63	3.0	220	28.8
4	0	5.5	18.07	6.9	220	20.8
5	0	0.7	11.06	N.A.	020	9.8
6	0	2.2	6.94	1.8	020	11.2
7	0	5.7	17.09	2.9	020	9.5
8	0	3.1	15.13	3.9	120	11.3
9	0	6.5	20.19	3.1	120	13.0
10	0	4.5	15.16	N.A.	130	12.4
11	0	-	1.88	N.A.	230	20.0
12	0	-	1.74	0.2	220	29.6
13	0	1.3	11.78	3.0	220	24.0
14	0	2.4	15.91	3.6	220	30.0
15	0	1.6	11.69	3.5	210	29.5
16	0	1.6	12.59	3.1	230	22.3
17	0	7.2	19.66	4.2	220	12.8
18	0	2.3	9.65	3.8	200	19.8
19	0	12.0	28.18	6.1	130	12.4
20	0	9.1	24.71	5.8	170	12.0
21	0	10.0	23.49	5.9	200	12.4
22	0	9.3	23.86	5.5	220	10.9
23	0	11.4	27.73	6.4	210	9.6
24	0	11.2	27.24	6.0	180	9.0
25	0	10.6	25.31	7.1	150	9.1
26	0	9.9	24.23	4.8	160	11.9
27	0	8.6	24.14	6.3	060	15.6
28	0	4.2	14.76	3.8	220	26.1
29	0	3.9	16.30	4.0	160	23.4
30	0	6.3	17.97	2.5	190	24.4
Mean/Total	1	173.5	17.82	119.4 ^{&}	220	18.0
Normal*	18.5 [§]	146.1	14.19	117.1	220	22.9
Station	Hong Kong International Airport	King's Park		Waglan Island [^]		

The minimum pressure recorded at the Hong Kong Observatory was 1002.7 hectopascals at 1628 HKT on 14 June.

The maximum air temperature recorded at the Hong Kong Observatory was 35.5 degrees C at 1556 HKT on 25 June.

The minimum air temperature recorded at the Hong Kong Observatory was 24.1 degrees C at 0547 HKT on 8 June.

The maximum gust peak speed recorded at Waglan Island was 77 kilometres per hour from 230 degrees at 1140 HKT on 12 June.

The maximum 1-minute mean rainfall rate recorded at King's Park was 187 millimetres per hour at 0643 HKT on 6 June.

Reduced visibility refers to visibility below 8 kilometres when there is no fog, mist or precipitation.

- The visibility readings at the Hong Kong International Airport are based on hourly observations by professional meteorological observers in 2004 and before, and average readings over the 10-minute period before the clock hour of the visibility meter near the middle of the south runway from 2005 onwards. The change of the data source in 2005 is an improvement of the visibility assessment using instrumented observations following the international trend.

- Before 10 October 2007, the number of hours of reduced visibility at the Hong Kong International Airport in 2005 and thereafter displayed in this web page was based on hourly visibility observations by professional meteorological observers. Since 10 October 2007, the data have been revised using the average visibility readings over the 10-minute period before the clock hour, as recorded by the visibility meter near the middle of the south runway.

^ In case the data are not available from Waglan Island, observations of Cheung Chau or other nearby weather stations will be incorporated in computing the Prevailing Wind Direction and Mean Wind Speed.

* 1981-2010 Climatological Normal, unless otherwise specified

§ 1997-2015 Mean value

& Data incomplete