QUARTERLY EM&A REPORT

The Jockey Club CPS Limited

Central Police Station Conservation and Revitalisation Project: *Eighth Quarterly EM&A Report* (1 August 2013 to 31 October 2013)

Issue Date: November 2013

Environmental Resources Management

16/F DCH Commercial Centre 25 Westlands Road Quarry Bay, Hong Kong Telephone: (852) 2271 3000 Facsimile: (852) 2723 5660 E-mail: post.hk@erm.com http://www.erm.com The Jockey Club CPS Limited

Central Police Station Conservation and Revitalisation Project: *Eighth Quarterly EM&A Report* (1 August 2013 to 31 October 2013)

Issue Date: November 2013 Reference 0095646

For and on behalf of			
ERM-Hong K	Long, Limited		
Approved by	: Frank Wan		
	Warderth T.		
Signed:			
Position:	Partner		
Certified by:	M		
	ronmental Team Leader – Winnie Ko)		
Date:	26 November 2013		

This report has been prepared by ERM-Hong Kong, Limited with all reasonable skill, care and diligence within the terms of the Contract with the client, incorporating our General Terms and Conditions of Business and taking account of the resources devoted to it by agreement with the client.

We disclaim any responsibility to the client and others in respect of any matters outside the scope of the above.

This report is confidential to the client and we accept no responsibility of whatsoever nature to third parties to whom this report, or any part thereof, is made known. Any such party relies on the report at their own risk.



阿特金斯 ATKINS 香港九龍尖沙咀海港城 九倉電訊中心十三樓 13/F Wharf T&T Centre Harbour City Tsim Sha Tsui Kowloon Hong Kong

www.atkinsglobal.com

Your ref.	Telephon 0095646_let_Atkins_20131127 Eighth Quarterly EM&A Report.doccsimile 5121189/OC055/SO	(852) 2972 1000 (852) 2890 6343
Our ref.		atkinsglobal.com

Date: 28 November 2013

By Email and Post

ERM-Hong Kong Limited, 16/F DCH Commercial Centre, 25 Westlands Road, Quarry Bay, Hong Kong

Attn: Ms Winnie Ko

Dear Winnie,

Central Police Station Conservation and Revitalization Project Verification of Eighth Quarterly EM&A Report

We refer to your letter dated 27 November 2013 regarding the eighth Quarterly EM&A Report. Atkins China Ltd. verifies, in the capacity of Independent Environmental Checker, that the report, in principle, conforms the requirements provided in Section 10.4 of the EM&A Manual.

Yours sincerely, For Atkins China Ltd.

Sharifah Or Independent Environmental Checker

c.c. HKJC – Mr. Kenneth Lee, Rocco Design Architect – Mr. Charles Kung, By Email By Email

	EXECUTIVE SUMMARY	Ι
1	INTRODUCTION	1
1.1	Purpose of the Report	1
1.2	STRUCTURE OF THE REPORT	1
2	PROJECT INFORMATION	3
2.1	BACKGROUND	3
2.2	SITE DESCRIPTION	3
2.3	CONSTRUCTION ACTIVITIES	3
2.4	CONSTRUCTION PROGRAMME	4
2.5	PROJECT ORGANISATION AND MANAGEMENT STRUCTURE	4
2.6	STATUS OF ENVIRONMENTAL APPROVAL DOCUMENTS	4
3	ENVIRONMENTAL MONITORING REQUIREMENTS	7
3.1	Noise Monitoring	7
3.2	Cultural Heritage	8
3.3	LANDSCAPE AND VISUAL MONITORING	10
4	IMPLEMENTATION STATUS ON ENVIRONMENTAL MITIGATION MEASURES	N 11
5	MONITORING RESULTS	12
5.1	Noise	12
5.2	LANDSCAPE AND VISUAL MONITORING	12
5.3	Cultural Heritage	13
5.4	WASTE MANAGEMENT	18
5.5	EFFECTIVENESS OF MITIGATION MEASURES AND MONITORING	18
6	ENVIRONMENTAL SITE INSPECTION	19
7	ENVIRONMENTAL NON-CONFORMANCE	21
8	REVIEW OF THE EM&A DATA AND EIA PREDICTIONS	23
8.1	NOISE	23
8.2	WASTE MANAGEMENT	23
8.3	SUMMARY OF REVIEW	21
9	CONCLUSIONS	25

LIST OF TABLES

- Table 2.1
 Summary of Construction Activities undertaken in this Reporting Period
- Table 2.2
 Summary of Environmental Licensing, Notification and Permit Status
- Table 3.1Construction Phase Noise Monitoring Locations
- Table 3.2Noise Monitoring Equipment
- Table 3.3Action and Limit Levels for Construction Noise Monitoring
- Table 3.4Alert, Alarm and Action (AAA) Levels for Vibration Monitoring
- Table 3.5Event and Action Plan for vibration monitoring
- Table 4.1Status of Required Submissions
- Table 5.1Findings of Monthly Tree Inspection in the Reporting Period
- Table 5.2Quantities of Waste Generated from the Project
- Table 7.1Summary of Complaints Received
- Table 8.1
 Comparison of Construction Noise Standard and Noise Monitoring Results
- Table 8.2Quantity of Actual Amount of C&D Materials, General Wastes and Chemical
 - Wastes Generated and EIA Estimation

LIST OF ANNEXES

Annex A	Locations of Works Areas and the Surroundings			
Annex A1	Project Location			
Annex A2	Declared Monuments within the Project Site			
Annex A3	Site Layout Plan marked with Works			
Annex B	Project Organization Chart and Contact Detail			
Annex C	Locations of Noise Monitoring Stations and Noise Sensitive Receivers			
Annex D	Monitoring Schedule of the Reporting Period			
Annex E	Calibration Reports for Calibrators and Sound Level Meters			
Annex F	Event/Action Plans for Noise			
Annex G	Summary of Implementation Status			
Annex H	Noise Monitoring Results			
Annex I	Construction Programme of the Project			
Annex J	Waste Flow Table			
Annex K	Environmental Complaint, Environmental Summons and Prosecution Log			
Annex L	Records of Vibration Monitoring for Trial Piling and Pipe / Bored Piling			
	Works			
Annex M	Records of Vibration Monitoring for Other Construction Works			
Annex N	A Summary of Current Condition of Character Defining Elements			

EXECUTIVE SUMMARY

The construction works of **Central Police Station Conservation and Revitalisation Project** commenced on 24 October 2011. This is the eighth quarterly Environmental Monitoring and Audit (EM&A) summary report presenting the EM&A works carried out during the period from 1 August 2013 and 31 October 2013 in accordance with the EM&A Manual.

Environmental Monitoring and Audit Progress

A summary of the monitoring activities undertaken in this reporting period is listed below:

•	Construction Noise Monitoring during normal weekdays at	
	each monitoring station	15 times
•	Joint Environmental Site Inspection	3 times
•	Heritage Site Inspection	53 times
•	Landscape & Visual Monitoring	3 times
•	Tree Inspection	3 times
•	Vibration monitoring for piling works	372 times
•	Vibration monitoring for other construction works	226 times

<u>Noise</u>

15 sets of 30-minute construction noise measurements were carried out at each of the monitoring stations (NM2 and NM6) during normal weekdays of the reporting period. No exceedance of the Action or Limit Level of construction noise was recorded during the reporting period.

Cultural Heritage

Trial Piling and Piling works

Vibration monitoring carried out for the trial piling and piling works during the reporting period are listed below:

- 76 vibration monitoring measurements for the construction of the pipe pile walls at Parade Ground;
- 75 vibration monitoring measurements for the foundation pile works at Block 8;
- 75 vibration monitoring measurements for the construction of pipe pile walls at Old Bailey Wing (Block 50);
- 75 vibration monitoring measurements for the shaft grouted pre-bored H-piles at Block 51; and
- 71 vibration monitoring measurements for the steel shear H-piles at Block 17.

Other Construction Works

Vibration monitoring carried out for other construction works during the reporting period are listed below:

- 76 vibration monitoring measurements for the structural addition and alteration works at Block 1;
- 75 vibration monitoring measurements for the structural addition and alteration works at Block 14; and
- 75 vibration monitoring measurements for the structural addition and alteration works at Block 11.

No exceedance of Alert, Alarm and Action Levels of vibration was recorded during the reporting period.

Fifty-three heritage site inspections were conducted and the Contractor has generally implemented the necessary protection measures as recommended.

Landscape & Visual

Landscape and visual monitoring has commenced since October 2011 on a monthly basis. Three monthly tree inspections have been conducted by the arborist during the reporting period. Most recommended actions have been performed by the Contractor as advised in the reporting period.

Waste Management

Wastes generated from this Project include inert construction and demolition (C&D) materials and non-inert C&D materials. 5,981.81 tonnes of inert C&D materials and 350.44 tonnes of non-inert C&D materials were generated during the reporting period. The non-inert C&D materials and general refuse generated from the Project were disposed of at the SENT Landfill. 14,340 kg of metal was produced and sent to recyclers for recycling. No plastics waste or paper/cardboard packaging was generated during the reporting period. 175 kg of solid chemical waste was produced and collected by licensed chemical waste collector during the reporting period.

Environmental Site Inspection

Three joint environmental site inspections were carried out by the representatives of the Contractor, the IEC and the ET during the reporting period. The Contractor has generally implemented the mitigation measures as recommended.

Environmental Exceedance/Non-conformance/Compliant/Summons and Prosecution

No exceedance of the Action or Limit Level of construction noise was recorded at designated monitoring stations during the reporting period. No exceedance of the Alert, Alarm and Action Levels of vibration was recorded during the reporting period.

No enquiry was received during the reporting period.

No non-compliance event was recorded during the reporting period.

No complaint was received during the reporting period.

No summons/prosecution was received in this reporting period.

1 INTRODUCTION

ERM-Hong Kong, Limited (ERM) was appointed by the Jockey Club CPS Limited (the CPS Ltd) as the Environmental Team (ET) to undertake the Environmental Monitoring and Audit (EM&A) programme for the **Central Police Station Conservation and Revitalisation Project** (the Project).

1.1 PURPOSE OF THE REPORT

This is the eighth quarterly EM&A summary report, which summarises the impact monitoring results and audit findings for the EM&A programme during the reporting period from 1 August 2013 and 31 October 2013.

1.2 STRUCTURE OF THE REPORT

The structure of the report is as follows:

Section 1 : **Introduction** details the scope and structure of the report.

Section 2: Project Information

summarises background and scope of the Project, site description, project organization and contract details, construction programme, the construction works undertaken and the status of Environmental Permit(s)/License(s) during the reporting period.

Section 3: Environmental Monitoring Requirements

summarises the monitoring parameters, monitoring programmes, monitoring methodologies, monitoring frequency, monitoring locations, Action and Limit Levels, Event/Action Plans, environmental mitigation measures as recommended in the EIA report, and relevant environmental requirements.

- Section 4 : **Implementation Status on Environmental Mitigation Measures** summarises the implementation of environmental protection measures during the reporting period.
- Section 5: **Monitoring Results** summarises the monitoring and waste management results obtained in the reporting period.

Section 6 : **Environmental Site Inspection** summarises the audit findings of the monthly site inspections undertaken within the reporting period.

Section 7: Environmental Non-conformance

summarises any monitoring exceedance, environmental complaints and environmental summons received within the reporting period.

Section 8: **Review of the EM&A Data and EIA Predictions** compares the monitoring data and waste quantity against predictions in the approved Project EIA report.

Section 9: Conclusions

2.1 BACKGROUND

The Chief Executive (CE)'s 2007-2008 Policy Address highlighted revitalisation as the guiding principle of heritage conservation and the Project was among one of the specific proposals put forward by the CE in the same Policy Address. At the meeting of the Executive Council (ExCo) on 15 July 2008, the ExCo advised and the CE ordered that Government should enter into a partnership with the Hong Kong Jockey Club (HKJC) in the form of an agreement (or agreements) to take forward the conservation and revitalisation of the CPS project based on various guiding parameters. The Project is now being undertaken in partnership with the Development Bureau of the HKSAR Government. The HKJC has taken on board the decision at the ExCo meeting and further investigated the design and implementation of the Project. The Project is now implemented by the CPS Limited.

2.2 SITE DESCRIPTION

The location of the Project Site is shown in *Annex A1*. The Site is bounded by Hollywood Road to the north, Arbuthnot Road to the east, Chancery Lane to the south and Old Bailey Street to the west.

The Site comprises three Declared Monuments designated under the *Antiquities and Monuments Ordinance* in 1995. They are:

- Central Police Station;
- Former Central Magistracy; and
- Victoria Prison Compound.

They are collectively named the Central Police Station (CPS). *Annex A2* shows the location of the Declared Monuments within CPS and the buildings within the CPS.

2.3 CONSTRUCTION ACTIVITIES

A summary of the major construction activities undertaken in this reporting period is shown in *Table 2.1* and illustrated in *Annex A3*.

Construction Activities Undertaken

- General strip out works at Block 2, Block 3, Block 4, Block 9, Block 10, Block 13 and Block 15 and Block 19;
- Structural addition and alteration works at Block 1 and Block 13;
- Roof tiling replacement works at Block 1 and Block 6;
- Demolition works at Block 2, Block 3, Block 6, Block 7, Block 11, Block 12, Block 14, Block 15 and Block 19;
- New structure construction at Block 11 and Block 15;
- Underpinning works at Block 1, Block 3 and Block 14;
- External and lateral support for cost plus at Block 10 and Block 13;
- Demolition of ground slab at Block 10 and Block 13;
- E&M opening at Block 6 and Block 7;
- Revetment wall strengthening of R175 and R806;
- Second masonry load test at Block 4;
- Basement construction at Parade Ground;
- Construction of manhole SMH22 (Block 10 and Block 13) for cost plus;
- Excavation and lateral support works at Parade Ground;
- Timber doors and windows repair works at Block 1, Block 3, Block 4, Block 6 and Block 7;
- E&M installation at Block 1;
- External scaffolding erection at Block 2, Block 4, Block 7 and Block 9;
- Old Bailey Wing piling works (Block 50) and Arbuthnot Wing (Block 51) load test preparation;
- Old Bailey Wing pump well installation and test;
- Removal of non-structural infill wall at Block 17;
- Shaft grouted mini piles at Block 8; and
- Second masonry wall load test at Block 4.

2.4 CONSTRUCTION PROGRAMME

The most updated construction programme for the Project is presented in *Annex I*.

2.5 PROJECT ORGANISATION AND MANAGEMENT STRUCTURE

The Project organization chart, hotline number and contact details are shown in *Annex B*.

2.6 STATUS OF ENVIRONMENTAL APPROVAL DOCUMENTS

A summary of the relevant permits, licences, and/or notifications on environmental protection for this Project since the granting of the EP in April 2011 is presented in *Table 2.2*.

Permit/ Licences/ Notification	Reference	Validity Period	Remarks
Environmental Permit (EP)	EP-408/2011	-	Superseded on 10 January 2012
	EP-408/2011/A	-	Superseded on 22 March 2012
	EP-408/2011/B	Throughout the Contract	Permit granted on 22 March 2012
Notification of Construction Works as required under <i>Air</i> <i>Pollution Control</i> (<i>Construction Dust</i>) <i>Regulation</i>	Ref. No. 332920	Throughout the Contract	-
Registration of Waste Producer under Waste Disposal Ordinance	Waste Producer No.: 5213-122-G2347-25	Throughout the Contract	-
Effluent Discharge License under Water Pollution Control Ordinance	License No. WT00010633-2011	21 Oct 2011 – 31 Oct 2016	-
Notification of Commencement of Asbestos Abatement Work under <i>Air</i> <i>Pollution Control</i> <i>Ordinance</i>	-	Throughout the Contract	EPD's letter (EPD's ref.: (5) in EPAC/A/4/000/23 3 II) dated 2 December 2011 satisfied that the content of the asbestos abatement plan (Report No.: 0210/11/ED/0078A) is in accordance with the APCO
Approval of Asbestos Abatement Work (Phase 2)	-	Earliest commencement date on 26 January 2012	EPD's letter (EPD's ref:() in EPAC/A/4/000/23 3) dated 18 January 2012.
Construction Noise Permit (CNP)	GW-RS0734-12	11 July 2012 at 0200 hours to 2 August 2012 at 0400 hours	Expired.
	GW-RS0839-12	13 August 2012 at 1900 hours to 31 December 2012 at 0700 hours	Expired.
	GW-RS1162-12	1 December 2012 at 0000 hours to 28 March 2013 at 0600 hours	Expired.
	GW-RS0113-13	1 February 2013 at 0200 hours to 31 May 2013 at 0400 hours	Expired.

Table 2.2Summary of Environmental Licensing, Notification and Permit Status

Permit/ Licences/ Notification	Reference	Validity Period	Remarks
	GW-RS1301-12	2 January 2013 at 1900 hours to 29 June 2013 at 2300 hours	Expired.
	GW-RS0084-13	24 January 2013 at 1900 hours to 29 June 2013 at 0700 hours	Expired.
	GW-RS0638-13	16 June 2013 at 0700 hours to 15 September 2013 at 1900 hours	Expired.
	GW-RS0901-13	14 August 2013 at 0000 hours to 31 October 2013 at 0600 hours	Expired.
	GW-RS0714-13	29 June 2013 at 1900 hours to 28 December 2013 at 2400 hours	-
	GW-RS0745-13	5 July 2013 at 1900 hours to 30 December 2013 at 2300 hours	-
	GW-RS1110-13	7 October 2013 at 0200 hours to 31 December 2013 at 0400 hours	-

3.1 NOISE MONITORING

3.1.1 Monitoring Location

The construction noise monitoring locations are given in *Table 3.1* and shown in *Annex C*.

Table 3.1Construction Phase Noise Monitoring Locations

Monitoring Location	Proposed Construction Noise Monitoring Station			itoring Station
	ID in EM&A Manual	ID	Type of Measurement	Remark
Rooftop of Ho Fook Building	N2	NM2	Façade	-
Rooftop of Chancery Mansion		NM6	Façade	Accesses to the original proposed monitoring location in the EM&A Manual, Chancery House (N5), were rejected; alternative location of Chancery Mansion (N6), were therefore proposed and approved by the Authorised Person (AP), the Independent Environmental Checker (IEC) and EPD.

The noise sensitive receivers are also shown in *Annex C*.

3.1.2 Monitoring Parameters, Frequency and Programme

Weekly construction noise monitoring was conducted in accordance with the requirements stipulated in the EM&A Manual. The monitoring programme for this reporting period is shown in *Annex D*.

The construction noise levels were measured in terms of A-weighted equivalent continuous sound pressure level (L_{eq}) in decibels dB(A). $L_{eq (30min)}$ were used as the monitoring parameter for the time period in between 0700 – 1900 hours on normal weekdays. Supplementary information for data auditing, two statistical sound levels L_{10} and L_{90} ; the levels exceeded for 10 and 90 percent of the time respectively, were also recorded during the monitoring for reference. The measured noise levels were logged in every 5 minutes throughout the impact monitoring period.

3.1.3 Monitoring Equipment and Methodology

Construction noise measurements were conducted in accordance with the calibration and measurement procedures as stated in *Annex – General Calibration and Measurement Procedures* of *Technical Memorandum on Noise from Construction Work other than Percussive Piling (GW-TM)* issued under the *Noise Control Ordinance (NCO)* (Cap 400).

The sound level meters and calibrator used for the noise measurement, as listed in *Table 3.2*, complies with IEC 651: 1979 and 804:1985 (Type 1) specification. The calibration certificates of the sound level meters are included in *Annex E*.

Table 3.2Noise Monitoring Equipment

Monitoring Stations	Monitoring Equipment (Sound Level Meter and Calibrator)
NM2, NM6	<u>Calibrator</u> Rion NC-73 (S/N 10786708)
	Sound Level Meter
	Rion NL-31 (S/N 00410224)

Immediately prior to and following the noise measurements, the accuracy of the measurement equipment was checked using an acoustic calibrator generating a known sound pressure level at a known frequency.

Measurements were accepted as the calibration level from before and after the noise measurement agree to within 1.0 dB.

3.1.4 Event / Action Plan

Table 3.3 Action and Limit Levels for Construction Noise Monitoring

Noise Monitoring Location	Action Level	Limit Level, L _{eq(30mins)} , dB(A)	Remark	
NM2, NM6	When one documented complaint is received from any one of the sensitive receivers	75 (note)	Applicable during 0700 – 1900 hours on normal weekdays.	
Notes:				
a) Acceptable Noise Levels for Area Sensitivity Rating of A/B/C. Limit Level is reduced to 70dB(A) for schools and 65dB(A) during school examination periods.				
b) If works are to) If works are to be carried out during restricted hours, the conditions stipulated in the CNP			

b) If works are to be carried out during restricted hours, the conditi issued by the NCA have to be followed.

The Event / Action Plan (EAP) for noise monitoring is presented in Annex F.

3.1.5 *Mitigation Measures*

The mitigation measures in accordance with the EP, EIA and EM&A Manual and their implementation status are presented in *Annex G*.

3.2 CULTURAL HERITAGE

3.2.1 Vibration Monitoring

In accordance with the EM&A Manual, vibration monitoring is required and the vibration control limits and vibration monitoring proposal are defined by a specialist for AMO's approval.

Baseline Monitoring

A set of initial readings should be recorded prior to commencement of each stage of demolition works or trial piling works. The baseline vibration monitoring should be conducted for duration of 5 minutes on the measurement day(s) at each vibration monitoring location.

Vibration Monitoring for Demolition Works

There are five phases/stages of vibration monitoring to be carried out for demolition works, namely Initial Reading Phase, Monitoring Stage 1, Monitoring Stage 2, Monitoring Stage 3 and Monitoring Stage 4. The monitoring location is shown in *Annex L*. The vibration monitoring should be conducted for duration of 5 minutes on the days with demolition works at each vibration monitoring location.

Vibration Monitoring for Trial Piling and Pipe/Bored Piling Works

Vibration monitoring for trial piling works and pipe/bored piling works is required. The monitoring location is shown in *Annex L*. The vibration monitoring should be conducted for duration of 5 minutes on the days with trial piling works or pipe/bored piling works at each vibration monitoring location.

Vibration Monitoring for Other Construction Works

Vibration monitoring for specific construction works other than demolition works, trial piling works and pipe/bored piling works is also required in accordance with Building Department's requirement. The monitoring location is shown in *Annex M*. The number and location of monitoring location will depend on the location of the specific construction works. The vibration monitoring should be conducted for duration of 5 minutes on a daily basis (working day) at each vibration monitoring location.

Alert, Alarm and Action Levels

The Alert, Alarm and Action (AAA) Levels are to be implemented during the vibration monitoring and shown in *Table 3.4*.

Table 3.4Alert, Alarm and Action (AAA) Levels for Vibration Monitoring

Instrument Type	Item Monitored	Alert Level	Alarm Level	Action Level
Vibration Monitoring	Horizontal Movement	2.0 mm/s	2.5 mm/s	3.0 mm/s

The Event / Action Plan (EAP) for vibration monitoring is shown in *Table 3.5*.

Events	Action
Exceedance of Alert Level	Notify Management Contractor
Exceedance of Alarm Level	Notify Authorised Person/ Resident Engineer
Exceedance of Action Level	Cease Works and submit mitigation

3.2.2 *Mitigation Measures*

Cultural heritage mitigation measures in accordance with the EP, EIA and EM&A Manual were implemented by the Contractor and the implementation status is given in *Annex G*.

3.3 LANDSCAPE AND VISUAL MONITORING

In accordance with the EM&A Manual, inspections of affected trees were conducted by an experienced and appropriately trained arborist. All irregularities that deviate from the recommended tree protection measures or could impose deleterious impacts on the protected trees were reported. Besides, implementation of mitigation measures for landscape and visual resources recommended in the EIA Report were also monitored during the site inspection.

3.3.1 Mitigation Measures

Landscape and visual mitigation measures in accordance with the EP, EIA and EM&A Manual were implemented by the Contractor and the implementation status is given in *Annex G*.

3.4 Environmental Requirements in Contract Documents

The environmental requirements as specified in the contract documents were reviewed and were covered in the EIA's requirements.

IMPLEMENTATION STATUS ON ENVIRONMENTAL MITIGATION MEASURES

The Contractor has generally implemented the environmental mitigation measures (including those for archaeology) and requirements as stated in the EIA Report, EM&A Manual, EP and the contract documents. The implementation status during the reporting period is summarised in *Annex G*.

Status of required submissions under the EP during the reporting period is presented in *Table 4.1*.

Submission		Submission Date
EP Condition		
Conditions 3.4	Twenty-first Monthly EM&A Report	14 August 2013
	Twenty-second Monthly EM&A Report	13 September 2013
	Twenty-third Monthly EM&A Report	16 October 2013
EM&A Manual		
Section 10.4	Seventh Quarterly EM&A Report	30 August 2013

Table 4.1Status of Required Submissions

4

5.1 NOISE

A total of 15 sets of 30-minute construction noise measurements were carried out at each monitoring station, NM2 and NM6, during normal weekdays of the reporting period. The monitoring results together with graphical presentations are presented in *Annex H*. The local impacts observed near the monitoring stations of NM2 and NM6 were summarised below:

- NM2: construction noise from activities in the Project Site and traffic noise from Old Bailey Street.
- NM6: construction noise from activities in the Project Site and traffic noise from Chancery Lane.

No exceedance of the Action or Limit Level of construction noise was recorded during the reporting period.

5.2 LANDSCAPE AND VISUAL MONITORING

Three monthly tree inspections were conducted by the arborist during the reporting period on 6 August 2013, 2 September 2013 and 2 October 2013 and key findings and recommendations are summarised in *Table 5.1*.

Table 5.1Findings of Monthly Tree Inspections in the Reporting Period

Tree No.	Botanical Name	Overall Health Condition	Arborist's Observation / Recommendations
6 August 2	013		
Tree -5	Mangifera indica	Good	Planter should be cleaned regularly;
			• Wounds were still on the lower trunk observed from the last reporting period. The lower trunk should be protected with hessian cloth;
			 Appropriate warning sign should be displayed in front of Tree-5.
Tree -6	Aleurites moluccana	Fair	• No further action required.
Tree-7	Aleurites moluccana	Fair	• No further action required.
Tree-8	Plumeria rubra	Fair	• No further action required.
Tree-9	Araucaria cunninghamia	Fair	• No further action required.
Tree-11	Dracaena marginata	Fair	Planter should be cleaned regularly;
			 Sharp edge of the scaffold nearby damaging the tree was

Tree No.	Botanical Name	Overall Health Condition	Arborist's Observation / Recommendations	
		Condition	still observed. The lower trunk should be protected with hessian cloth;	
			 Appropriate warning sign should be displayed in front of Tree-11. 	
2 Septembe	r 2013			
Tree -5	Mangifera indica	Good	Planter should be cleaned regularly;	
			• To complete the nearby renovation work as soon as possible so as to minimise disturbance to the tree.	
Tree -6	Aleurites moluccana	Fair	• No further action required.	
Tree-7	Aleurites moluccana	Fair	• No further action required.	
Tree-8	Plumeria rubra	Fair	• No further action required.	
Tree-9	Araucaria cunninghamia	Fair	• No further action required.	
Tree-11	Dracaena marginata	Fair	• To complete the nearby renovation work as soon as possible so as to minimise the disturbance to the tree.	
2 October 2	2013			
Tree -5	Mangifera indica	Good	• No further action required.	
Tree -6	Aleurites moluccana	Fair	• No further action required.	
Tree-7	Aleurites moluccana	Fair	• No further action required.	
Tree-8	Plumeria rubra	Fair	• No further action required.	
Tree-9	Araucaria cunninghamia	Fair	• No further action required.	
Tree-11	Dracaena marginata	Fair	• No further action required.	

Follow-up actions needed to be implemented were recommended to the Contractor and the status of the follow-up actions was reviewed during the subsequent monthly site inspections. Recommendations have generally been implemented by the Contractor during the reporting period.

5.3 CULTURAL HERITAGE

5.3.1 Vibration Monitoring

Trial Piling and Piling works

Vibration monitoring carried out for the trial piling and piling works during the reporting period are listed below:

August 2013:

• 27 vibration monitoring measurements for the construction of the pipe pile walls at Parade Ground;

- 26 vibration monitoring measurements for the foundation pile works at Block 8;
- 26 vibration monitoring measurements for the construction of pipe pile walls at Old Bailey Wing (Block 50);
- 26 vibration monitoring measurements for the shaft grouted pre-bored H-piles at Block 51;
- 26 vibration monitoring measurements for the steel shear H-piles at Block 17; and

September 2013:

- 24 vibration monitoring measurements for the construction of the pipe pile walls at Parade Ground;
- 24 vibration monitoring measurements at Block 8;
- 24 vibration monitoring measurements for the construction of pipe pile walls at Old Bailey Wing (Block 50);
- 24 vibration monitoring measurements for the shaft grouted pre-bored H-piles at Block 51;
- 24 vibration monitoring measurements at Block 17.

October 2013:

- 25 vibration monitoring measurements for the construction of the pipe pile walls at Parade Ground;
- 25 vibration monitoring measurements at Block 8;
- 25 vibration monitoring measurements for the construction of pipe pile walls at Old Bailey Wing (Block 50);
- 25 vibration monitoring measurements for the shaft grouted pre-bored H-piles at Block 51; and
- 21 vibration monitoring measurements at Block 17.

The monitoring results are presented in *Annex L*.

Other Construction Works

Vibration monitoring carried out for other construction works during the reporting period are listed below:

August 2013:

- 27 vibration monitoring measurements for the structural addition and alteration works at Block 1;
- 26 vibration monitoring measurements for the structural addition and alteration works at Block 14; and
- 26 vibration monitoring measurements for the structural addition and alteration works at Block 11.

September 2013:

- 24 vibration monitoring measurements for the structural addition and alteration works at Block 1;
- 24 vibration monitoring measurements for the structural addition and alteration works at Block 14; and
- 24 vibration monitoring measurements for the structural addition and alteration works at Block 11.

October 2013:

- 25 vibration monitoring measurements for the structural addition and alteration works at Block 1;
- 25 vibration monitoring measurements for the structural addition and alteration works at Block 14; and
- 25 vibration monitoring measurements for the structural addition and alteration works at Block 11.

The monitoring results are presented in Annex M.

All monitoring results were below the Alert/ Alarm/ Action Levels.

5.3.2 Heritage Site Audit

Heritage site audits were conducted on 1, 6, 8, 9, 12, 13, 15, 19, 20, 21, 22, 23, 26, 27, 28 and 29 August 2013; 2, 3, 5, 6, 10, 11, 12, 13, 17, 18, 19, 23, 24, 25, 26, 27 and 30 September 2013; 2, 3, 4, 8, 9, 10, 11, 15, 16, 17, 18, 21, 22, 23, 24, 25, 28, 29, 30 and 31 October 2013 by the Heritage Checker during the reporting period. Follow-up actions were undertaken as reported by the Contractor and observed in the subsequent monthly site inspections conducted in the reporting period. Key site audit findings and recommendations are summarised below.

15 August 2013

• It was observed that Room 01/F/01 and 01/F/27 in Block 1 was flooded.

- Timber doors, window frames, ceramic tiles, etc were observed not fully protected in Block 1. The Contractor was reminded to maintain proper protection.
- Some signs in Block 3 (e.g. third floor) were observed not protected.

21 August 2013

• A worker was observed pouring a large tank of water through window 14/WS/24 in Block 14. The worker was stopped immediately.

26 August 2013

• It was observed that some tiles have been damaged following the modern lobby screen removal on Ground Floor of Block 9. The Contractor was informed immediately to remove the damaged tiles.

27 August 2013

• It was observed that the glazing tiles were not protected prior to the carrying out of the demolition of masonry for E&M openings. Brick dust was observed over the glazed tiles caused damage to a number of the glazed tile moulded capping.

29 August 2013

• It was observed that the storage of timber floor boards is unsatisfactory and potential warping of the boards may occur.

3 September 2013

• It was observed that the door frame to 01/DG/78 and picture rail were not protected before demolition of masonry for E&M openings carried out to the wall between room 01/G/18 and 01/G/20.

6 September 2013

• It was noticed that window 01/WLG2/30 timber frame has been damaged.

10 September 2013

• Door frame 01/DG/57 was observed lack of protection when demolition was being carried out to the wall above. Site memo 106 was subsequently issued on 24 September 2013 to the Contractor for follow-up rectification.

12 September 2013

• It was observed that the protection to the Character Defining Elements (CDEs) were not sufficient in general. This information was included in

the site memo 106 issued on 24 September 2013 to the Contractor for follow-up rectification.

13 September 2013

• The timber door frames on LG2 of Block 1 were observed damaged due to lack of protection.

18 September 2013

• The timber frames of 03/DG/04/05/06 were observed unprotected with scaffold components stored nearby.

24 September 2013

- It was noticed that the CDEs in Ground Floor of Block 1 was still lack of protection. Site memo 106 was issued on the same day to the Contractor for follow-up rectification.
- The replacement of timber threshold in First Floor of Block 3 was in a wrong profile with design instruction. The Contractor was informed to re-do the work.

25 September 2013

• It was observed that three core drill holes in the central staircase area of Block 1 were created in locations that are not in accordance with the photo signing of record.

26 September 2013

• Moulded skirting was observed unprotected while external opening was formed to Room 01/LG1/51 in Block 1.

8 October 2013

• It was noticed that mark-up of openings in Block 2 were mostly incorrect or missing.

10 October 2013

• Cigarette buds were observed in one of the paint pots on the first floor of Block 1.

16 October 2013

• It was observed that scaffold components were placed on the unprotected timber floor boards on second floor of Block 4 and second floor of Block 3.

17 October 2013

• It was observed that scaffold components were placed on the unprotected timber floor boards on second floor of Block 4.

A summary of the current condition of character defining elements, historic buildings and structures is contained in *Annex N*.

5.4 WASTE MANAGEMENT

Wastes generated from this Project include inert construction and demolition (C&D) materials and non-inert C&D materials. Non-inert C&D materials were made up of wastes such as general refuse. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting period are summarised in *Table 5.2*. The summary of Waste Flow Table prepared by the Contractor is shown in *Annex J*. The non-inert C&D materials and general refuse generated from the Project were disposed of at the SENT Landfill. 14,340 kg of metal was produced and sent to recyclers for recycling. No plastics waste or paper/cardboard packaging was generated during the reporting period. 175 kg of solid chemical waste was produced and collected by licensed chemical waste collector during the reporting period.

Month / Year	Quantity						
	C&D	C&D	Chemical		Recycled materials		
	Materials	Materials	Waste				
	(inert)	(non-inert)	Liquid	Solid	Paper/cardboard	Plastics	Metals
	(tonnes) ^(a)	(tonnes) ^(b)	(L)	(kg)	(kg)	(kg)	(kg)
August 2013	2,831.78	89.23	0	0	0	0	7,190
September 2013	979.49	103.73	0	40	0	0	4,030
October 2013	2,170.54	157.48	0	135	0	0	3,120
Total	5,981.81	350.44	0	175	0	0	14,340

Table 5.2Quantities of Waste Generated from the Project

Notes:

(a) Inert C&D materials include bricks, concrete, building debris, rubble and excavated soil.

(b) Non-inert C&D materials include wastes such as general refuse which were disposed of at SENT Landfill and recyclable materials are paper, cardboard, plastics and metals. The figure presented under non-inert C&D materials represents quantities of non-recyclable materials. Recycled materials are reported separately.

5.5

EFFECTIVENESS OF MITIGATION MEASURES AND MONITORING

The mitigation measures recommended in the EIA report and required by the EP are considered effective in minimising environmental impacts.

The EM&A for the Project was conducted as scheduled during the reporting period. No non-compliance events were observed during site inspections and no exceedances were recorded during the reporting period. The EM&A programme is considered effective.

Three monthly environmental site inspections were conducted on 15 August 2013, 12 September 2013 and 17 October 2013 during the reporting period. There was no non-compliance recorded during the site inspections. Key site audit findings and recommendations are summarised below. Monthly recommendations and observations were implemented and rectified by the Contractor in the subsequent monthly site inspections.

15 August 2013

• Washing of concrete materials was observed near the Parade Ground. The Contractor was reminded to wash the concrete materials on tarpaulin at all times and to ensure that all water used is directed to the wastewater treatment facility for treatment.

12 September 2013

• Nil.

17 October 2013

• Nil.

This page is deliberately left blank

7 ENVIRONMENTAL NON-CONFORMANCE

7.1.1 Summary of Monitoring Exceedance

No exceedance of the Action or Limit Level of construction noise or Alert, Alarm and Action Level of vibration was recorded during the reporting period.

7.1.2 Summary of Enquiry

No enquiry was received during the reporting period.

7.1.3 Summary of Environmental Non-Compliance

No non-compliance event was recorded during the reporting period.

7.1.4 Summary of Environmental Complaint

No complaint was received during the reporting period. The cumulative number of complaints is presented in *Annex K*.

7.1.5 Summary of Environmental Summons and Successful Prosecution

No summons was received during the reporting period. The cumulative summons/prosecution log is shown in *Annex K*.

This page is deliberately left blank

8.1 NOISE

A comparison was made between the monitoring results in this reporting period and the Noise Standard for general construction works during 0700 – 1900 hrs on normal weekdays (*Table 8.1*).

Table 8.1Comparison of Construction Noise Standard and Noise Monitoring Results

Reporting Month	Monitoring Stations	Corresponding NSR in EIA	Noise Limit Level	Predicted Construction Noise Level (With Mitigation) in EIA	Measured Construction Noise Level
			L _{eq, 30 min} dB(A)	L _{eq, 30 min} dB(A)	L _{eq, 30 min} dB(A)
Aug 2013	NM2	N2	75	67 - 72	68.1 – 73.6
	NM6	N6	75	73 - 75	67.3 - 68.6
Sep 2013	NM2	N2	75	67 - 72	66.5 - 69.3
	NM6	N6	75	73 - 75	67.9 - 70.7
Oct 2013	NM2	N2	75	67 - 72	67.6 - 70.2
	NM6	N6	75	73 - 75	67.3 - 69.7

The monitoring results recorded since the commencement of the construction works have been below the Limit Level and comparable to the predicted construction noise level in the approved EIA. Recommended mitigation measures in *Section 5.9.1* of EIA will continue to be implemented throughout the construction stage.

8.2 WASTE MANAGEMENT

The estimated amount of waste generated in the approved EIA and the accumulated quantities of waste generated up to this reporting period are presented in *Table 8.2*. The accumulated amount of inert and non-inert C&D materials is within the estimated amount in EIA. The major chemical waste generated on site was primarily asbestos which was not estimated in the approved EIA and hence no data is available for comparison. Recommended mitigation measures in *Section 8.5.1* of the EIA will continue to be implemented throughout the construction stage.

8

Table 8.2Quantity of Actual Amount of C&D Materials, General Wastes and Chemical
Wastes Generated and EIA Estimation

Type of Material	Estimated Amount of Waste in EIA	Accumulated Actual Amount of Waste Recorded ^{(a) (b)}
Amount of C&D Materials (Inert) Arising	16,440 m ³	14,464 m ³
Amount of C&D Materials (Non-inert) Arising	890 m ³	3,076 m ³
General Refuse	130 kg per day	_ (c)
Chemical Waste	Less than 100L per month	- 57 L (liquid)
		- 350 kg (solid)
		- 7,000 kg of asbestos generated

Notes:

(a) The accumulated actual amount of C&D Materials was recorded since the commencement of construction works.

(b) The volume of waste materials are provided by the Contractor based on the updated waste record in October 2013.

(c) The amount of general refuse generated was not recorded.

8.3 SUMMARY OF REVIEW

The EIA predictions and the monitoring results since the commencement of construction works have been reviewed. The EIA concluded that the Project would not cause adverse impacts to the environment and the monitoring results have also indicated the same so far. Mitigation measures (including those for archaeology) recommended in the EP, EIA and EM&A Manual were implemented by the Contractor as far as practicable and were considered effective. The recommended mitigation measures will continue to be implemented throughout the construction phase of the Project.

The effectiveness of the monitoring programme has been exhibited therefore change to the programme is not considered to be necessary.

9 CONCLUSIONS

This eighth Quarterly EM&A Report presents the EM&A works undertaken during the reporting period from 1 August 2013 to 31 October 2013 in accordance with EM&A Manual and the requirements under EP-408/2011/B.

No exceedance of the Action or Limit Level of construction noise was recorded at designated monitoring stations during the reporting period.

Tree inspections were conducted in this reporting period. Most of the necessary landscape and visual mitigation measures recommended in the EIA Report were implemented by the Contractor.

No exceedance of the Alert, Alarm and Action Levels of vibration was recorded during the reporting period.

No enquiry was received during the reporting period.

No non-compliance event for heritage and environmental site inspections was recorded during the reporting period.

No complaint was received during the reporting period.


No summons/prosecution was received during the reporting period.

The monitoring programme was considered effective in reflecting the environmental conditions at the designated representative sensitive receivers. The monitoring results also indicate that the Project have not caused adverse impacts on the environment with implementation of appropriate mitigation measures. Change to the monitoring programme is not considered to be necessary. The ET will keep track on the EM&A programme to ensure compliance of environmental requirements and the proper implementation of all necessary mitigation measures in the coming periods. Annex A

Location of Works Areas and the Surroundings


Annex A1

Project Location

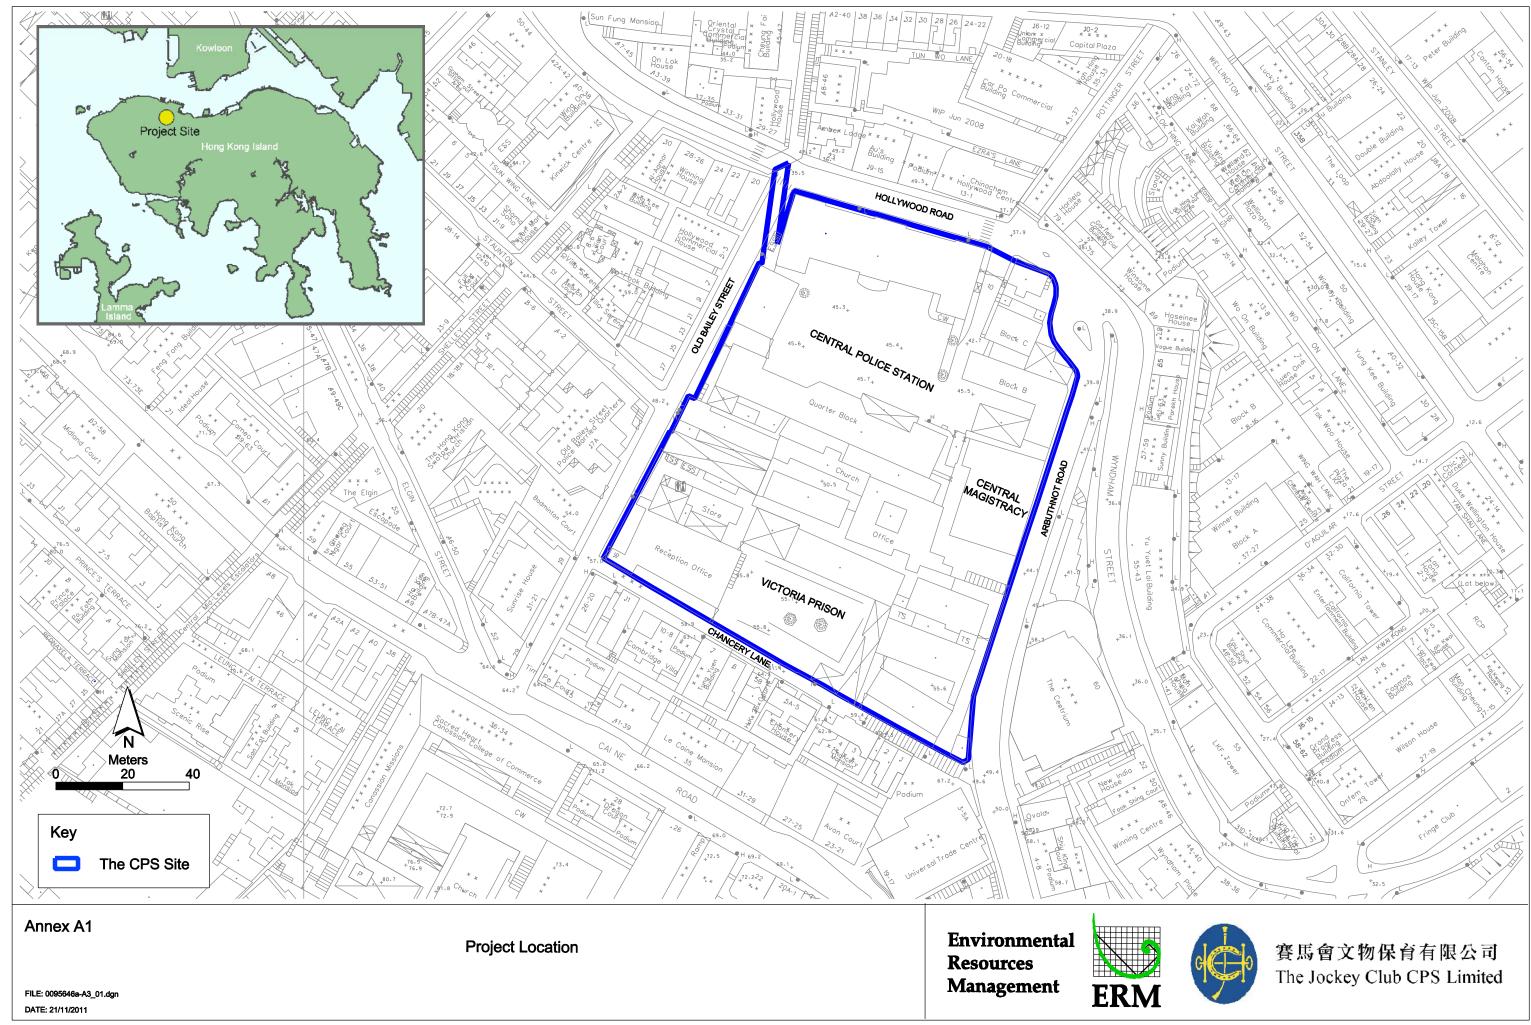

Annex A2


Declared Monuments within the Project Site

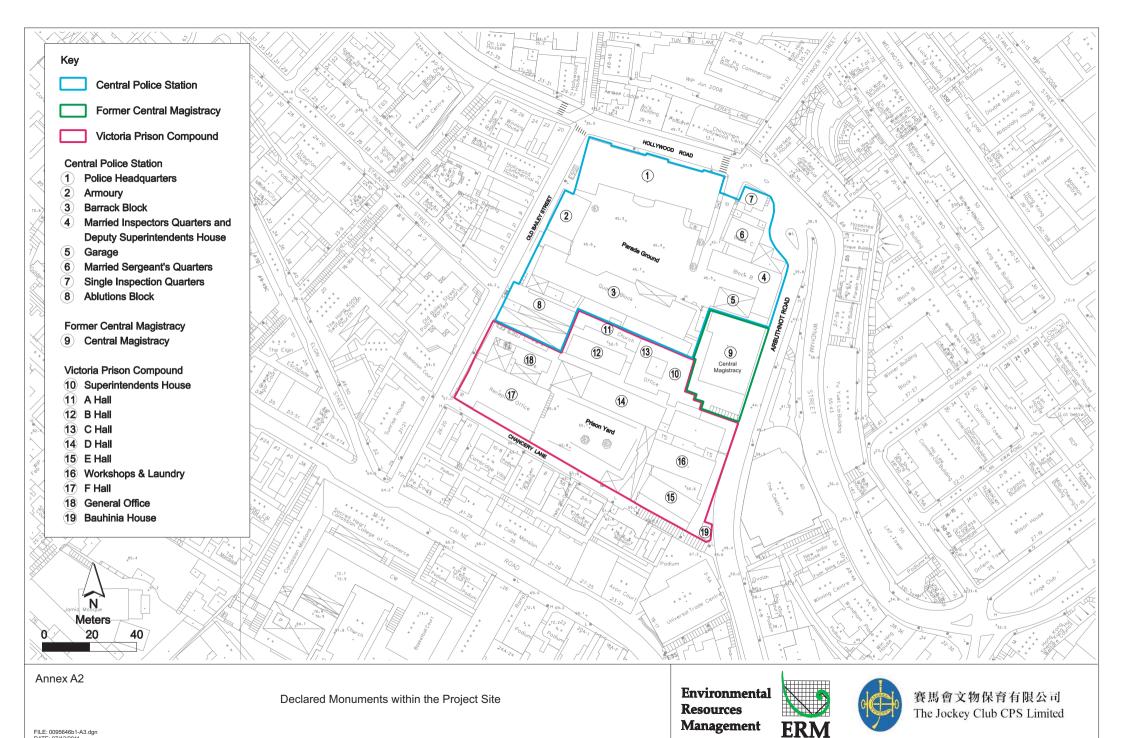


FILE: 0095646b1-A3.dgn DATE: 07/12/2011

Annex A3


Site Layout Plan marked with Works

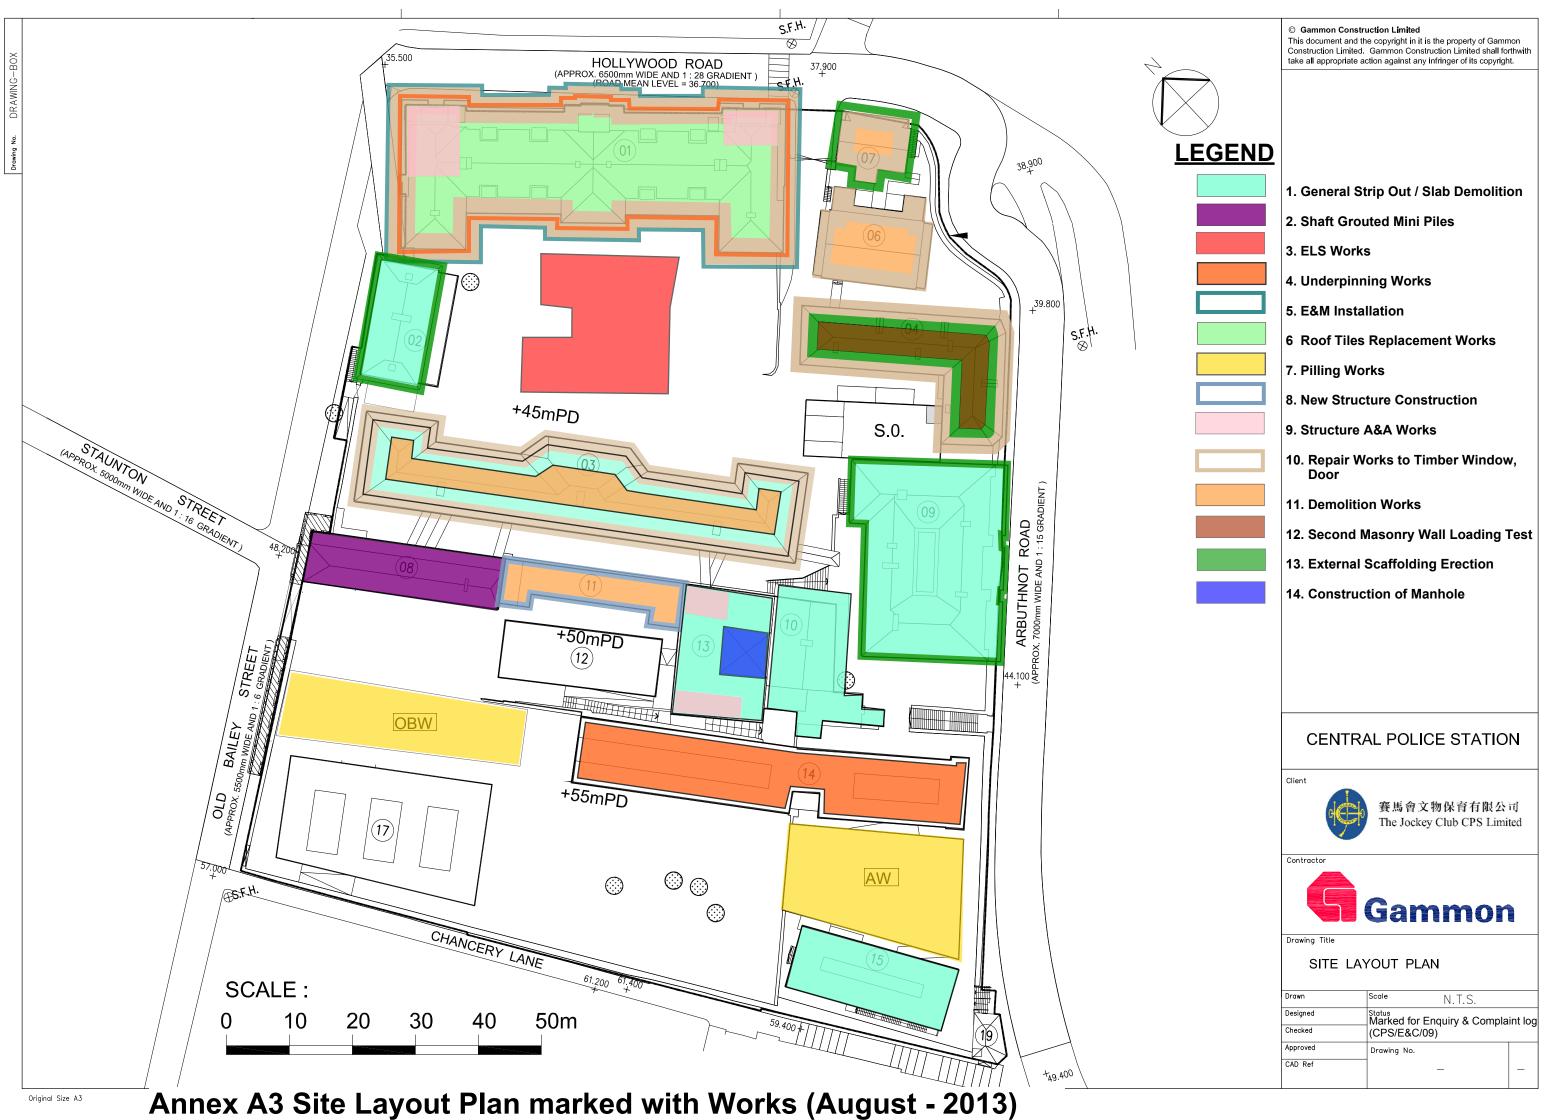

AST_UPDAT

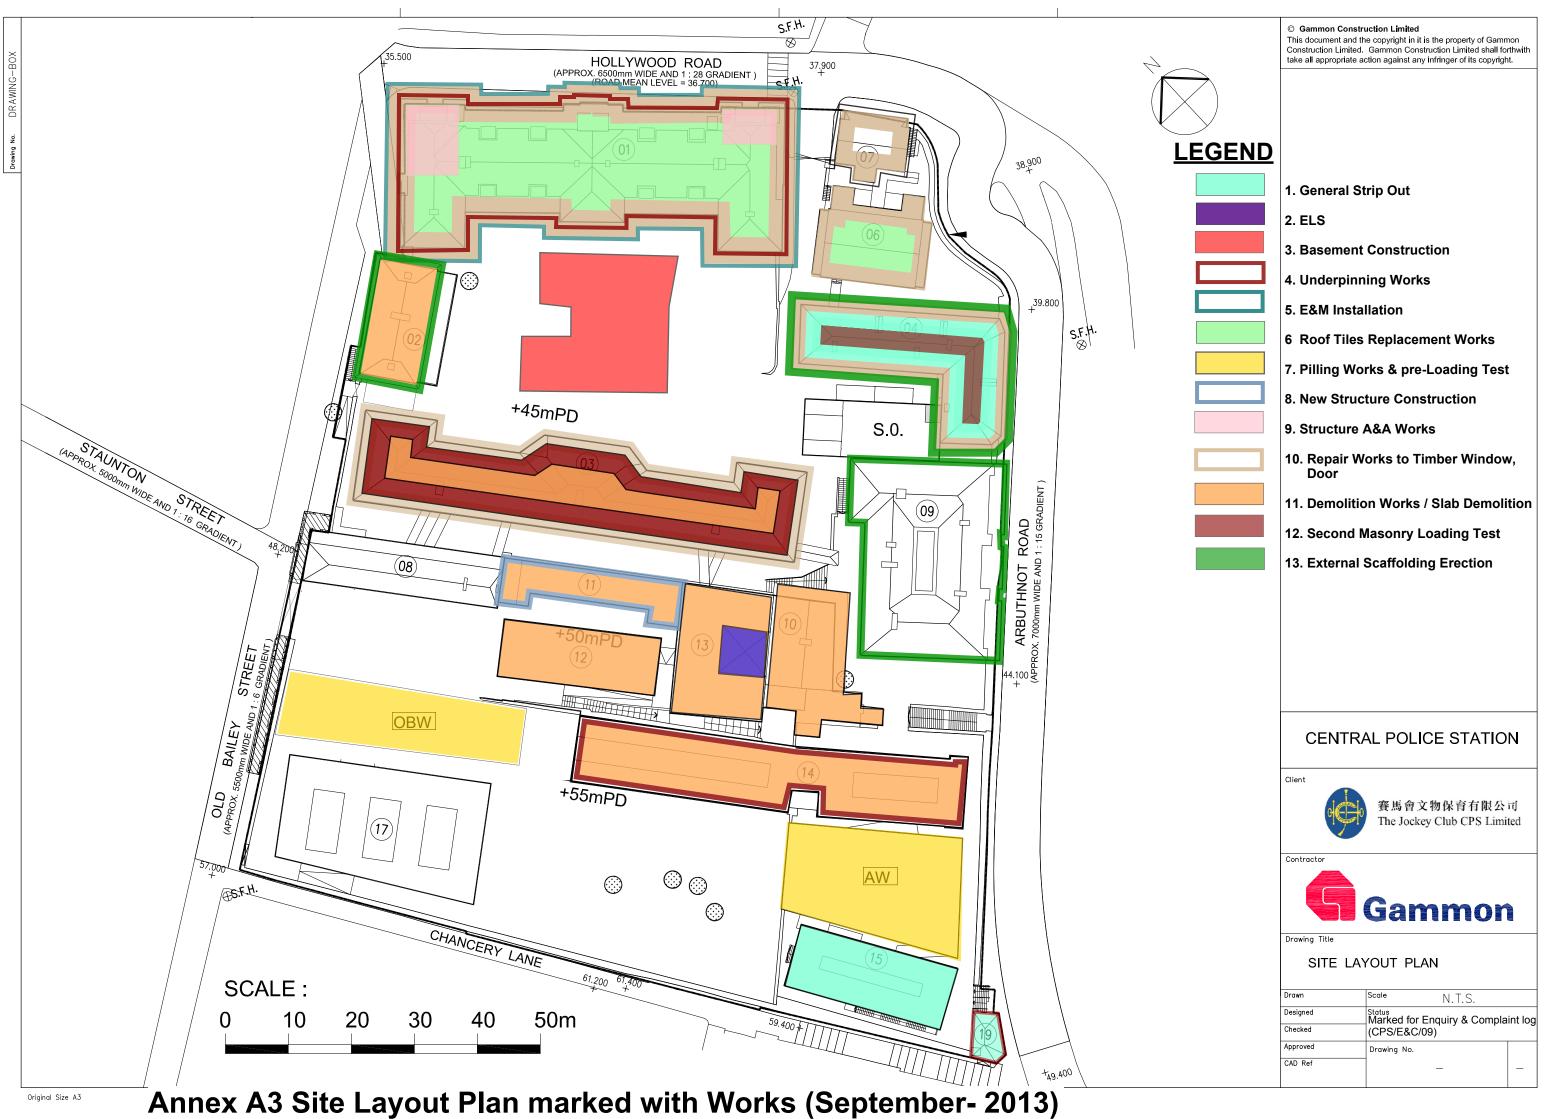


AST_UPDA

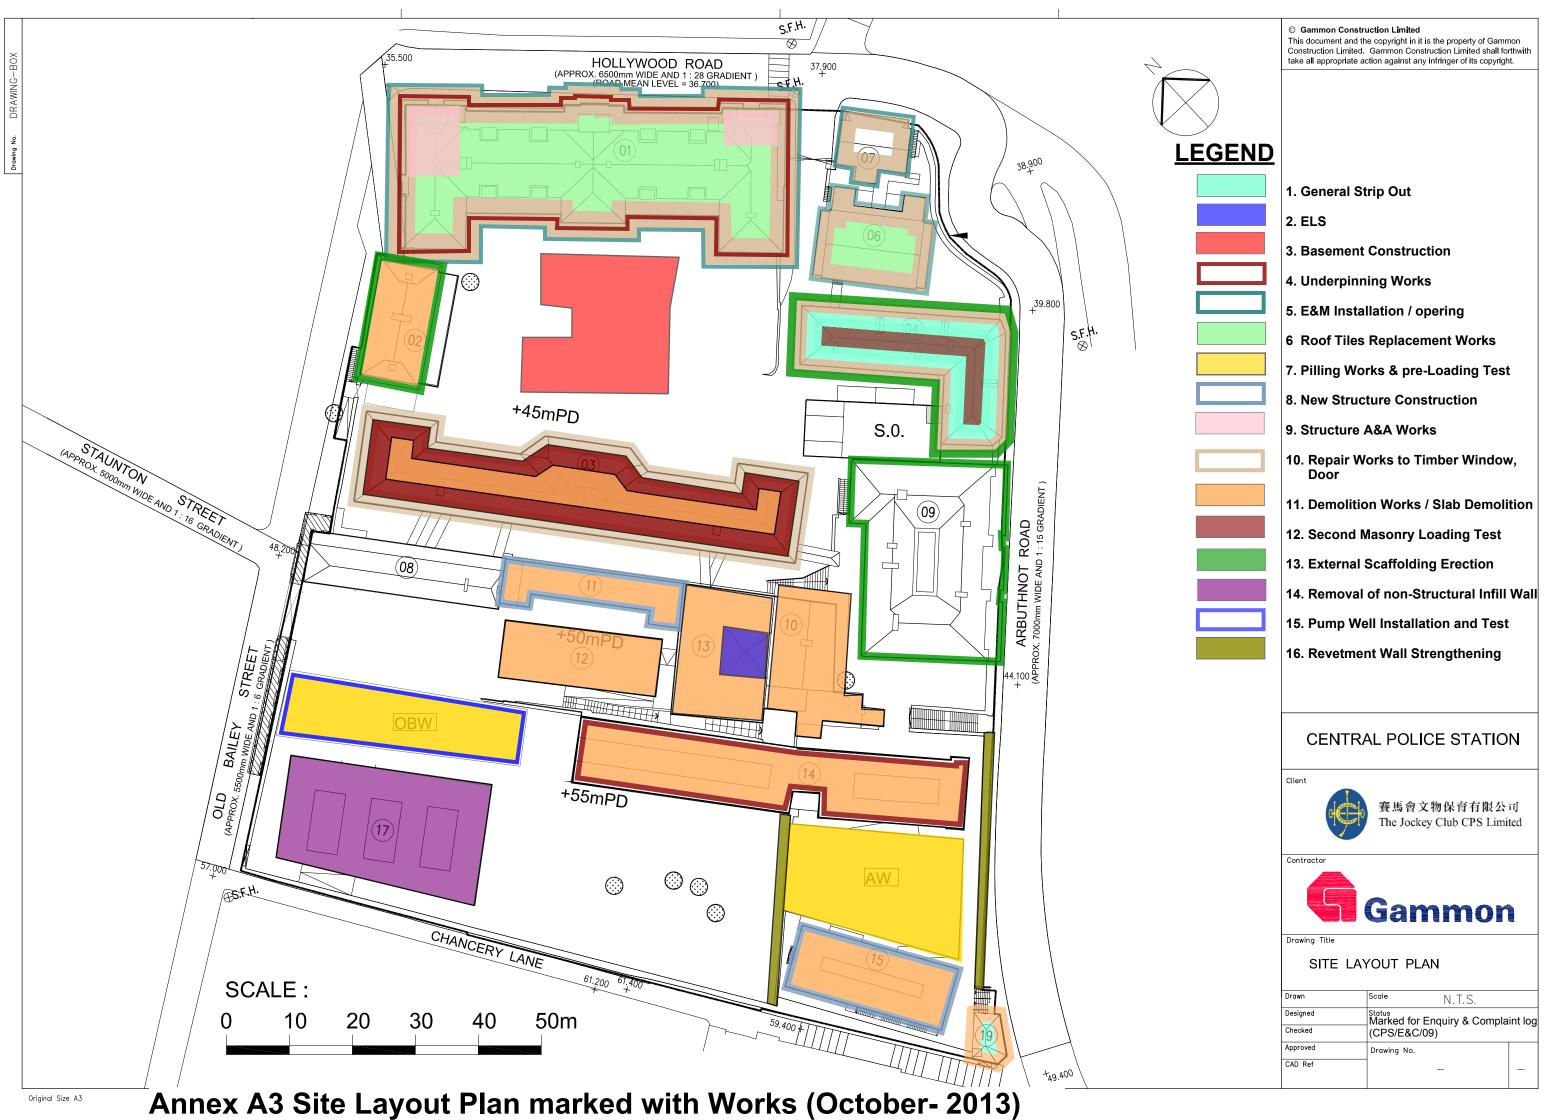

LAST_UPDATE


Annex B

Project Organization Chart and Contact Detail

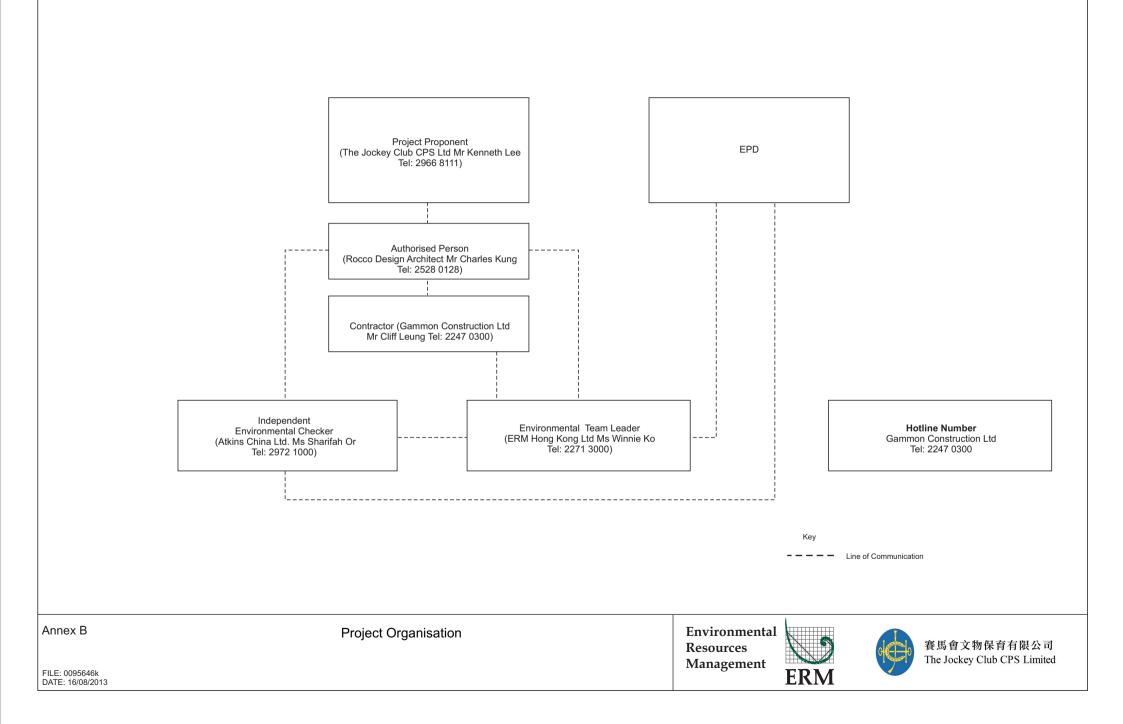

Annex C

Locations of Noise Monitoring Stations and Noise Sensitive Receivers

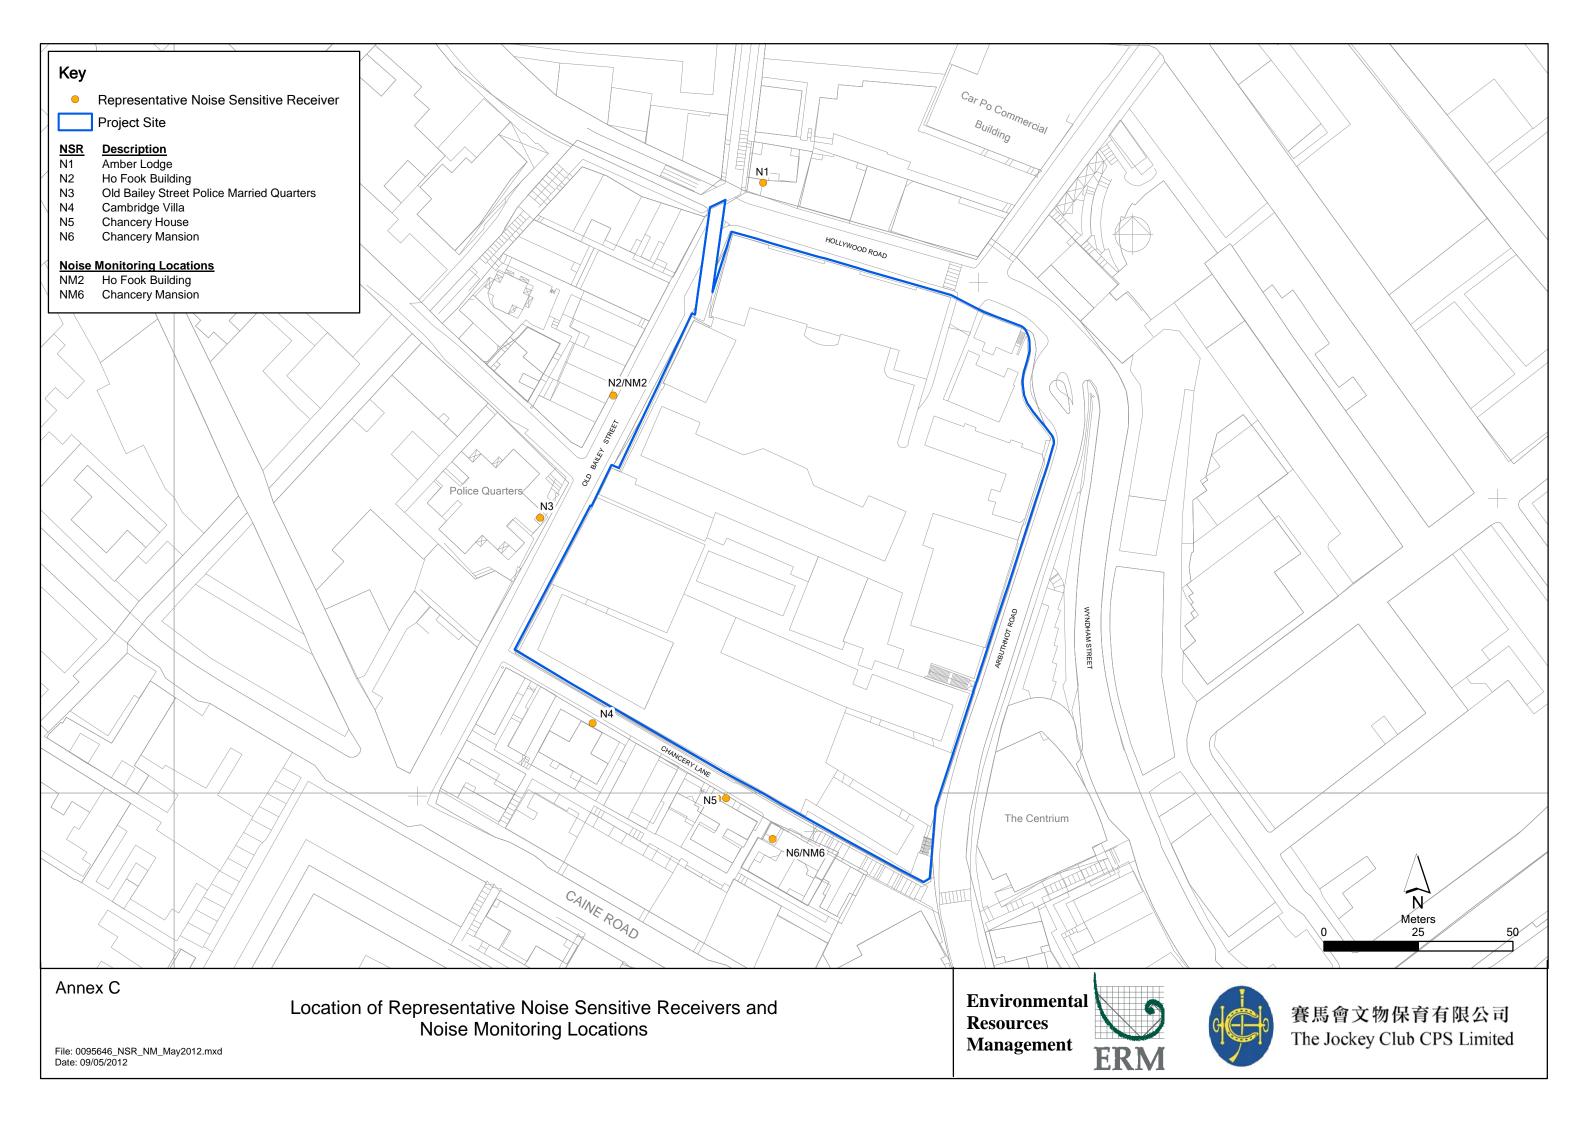

Annex D

Monitoring Schedule of the Reporting Period

Central Police Station Compound Conservation and Revitalisation (Ho Fook Building - NM2 & Chancery Mansion - NM6) Monitoring Schedule for Reporting Month - August 2013

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				01-Aug	02-Aug	03-Aug
04-Aug	05-Aug	06-Aug	07-Aug	08-Aug	09-Aug	10-Aug
		Noise Monitoring				
		at NM2 & NM6				
11	10 4	10 4	14 0	15 Aug	10 4.00	17
11-Aug	12-Aug	13-Aug	14-Aug	15-Aug	16-Aug	17-Aug
	Noise Monitoring					Noise Monitoring
	at NM2 & NM6					at NM2 & NM6
18-Aug	19-Aug	20-Aug	21-Aug	22-Aug	23-Aug	24-Aug
	0		0			
					Noise Monitoring	
					at NM2 & NM6	
25-Aug	26-Aug	27-Aug	28-Aug	29-Aug	30-Aug	31-Aug
				Noise Monitoring		
				at NM2 & NM6		

Central Police Station Compound Conservation and Revitalisation (Ho Fook Building - NM2 & Chancery Mansion - NM6) Monitoring Schedule for Reporting Month - September 2013

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
01-Sep	02-Sep	03-Sep	04-Sep	05-Sep	06-Sep	07-Sep
			Noise Monitoring at NM2 & NM6			
08-Sep	09-Sep	10-Sep	11-Sep	12-Sep	13-Sep	14-Sep
		Noise Monitoring at NM2 & NM6				
15-Sep	16-Sep	17-Sep	18-Sep	19-Sep	20-Sep	21-Sep
	Noise Monitoring at NM2 & NM6					Noise Monitoring at NM2 & NM6
22-Sep	23-Sep	24-Sep	25-Sep	26-Sep	27-Sep	28-Sep
					Noise Monitoring at NM2 & NM6	
29-Sep	30-Sep					

Central Police Station Compound Conservation and Revitalisation (Ho Fook Building - NM2 & Chancery Mansion - NM6) Monitoring Schedule for Reporting Month - October 2013

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		01-Oct	02-Oct	03-Oct	04-Oct	05-Oct
				Noise Monitoring at NM2 & NM6		
06-Oct	07-Oct	08-Oct	09-Oct	10-Oct	11-Oct	12-Oct
			Noise Monitoring at NM2 & NM6			
13-Oct	14-Oct	15-Oct	16-Oct	17-Oct	18-Oct	19-Oct
		Noise Monitoring at NM2 & NM6				
20-Oct	21-Oct	22-Oct	23-Oct	24-Oct	25-Oct	26-Oct
	Noise Monitoring at NM2 & NM6					Noise Monitoring at NM2 & NM6
27-Oct	28-Oct	29-Oct	30-Oct	31-Oct		

Annex E

Calibration Reports for Calibrators and Sound Level Meters



Certificate No.: C133573 證書編號

ITEM TESTED / 送檢項	目	(Job No. / 序引編號:IC13-1422)
Description / 儀器名稱 :		Sound Level Meter
Manufacturer / 製造商 :		Rion
Model No. / 型號 :		NL-31
Serial No. / 編號 :		00410224
Supplied By / 委託者 :		Envirotech Services Co.
		Shop 6, G/F., Casio Mansion, 209 Shaukeiwan Road,
		Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Line Voltage / 電壓 : --- Relative Humidity / 相對濕度 : (55 ± 20)%

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 14 June 2013

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only. All results are within manufacturer's specification. The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA
- Agilent Technologies, USA

Tel/電話: 2927 2606 Fax/傳真: 2744 8986

Tested By 測試	:	K C Lee			
Certified By 核證	:	K K Wong	Date of Issue 簽發日期	:	17 June 2013

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

Website/網址: www.suncreation.com

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

E-mail/電郵: callab@suncreation.com

Page 1 of 3



Certificate No. : C133573 證書編號

- 1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- 2. Self-calibration was performed before the test.
- 3. The results presented are the mean of 3 measurements at each calibration point.
- 4. Test equipment :

<u>Equipment ID</u>	<u>Description</u>	<u>Certificate No.</u>
CL280	40 MHz Arbitrary Waveform Generator	C130019
CL281	Multifunction Acoustic Calibrator	DC110233

- 5. Test procedure : MA101N.
- 6. Results :
- 6.1 Sound Pressure Level
- 6.1.1 Reference Sound Pressure Level

	UU	JT Setting		Applied	Value	UUT	IEC 61672 Class 1
Range	Mode	Frequency	Time	Level	Freq.	Reading	Spec.
(dB)		Weighting	Weighting	(dB)	(kHz)	(dB)	(dB)
30 - 120	LA	А	Fast	94.00	1	93.6	± 1.1

6.1.2 Linearity

	UU	JT Setting		Applied	l Value	UUT
Range	Mode	Frequency	Time	Level	Freq.	Reading
(dB)		Weighting	Weighting	(dB)	(kHz)	(dB)
30 - 120	L _A	A	Fast	94.00	1	93.6 (Ref.)
				104.00		103.6
				114.00		113.6

IEC 61672 Class 1 Spec. : \pm 0.6 dB per 10 dB step and \pm 1.1 dB for overall different.

6.2 Time Weighting

	UU	T Setting		Applied	l Value	UUT	IEC 61672 Class 1
Range	Mode	Frequency	Time	Level	Freq.	Reading	Spec.
(dB)		Weighting	Weighting	(dB)	(kHz)	(dB)	(dB)
30 - 120	L _A	А	Fast	94.00	1	93.6	Ref.
			Slow			93.5	± 0.3

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Certificate No. : C133573 證書編號

6.3 Frequency Weighting

6.3.1 A-Weighting

A-weighting							
	UU	T Setting		Appl	ied Value	UUT	IEC 61672 Class 1
Range	Mode	Frequency	Time	Level	Freq.	Reading	Spec.
(dB)		Weighting	Weighting	(dB)	-	(dB)	(dB)
30 - 120	L _A	А	Fast	94.00	63 Hz	67.3	-26.2 ± 1.5
					125 Hz	77.3	-16.1 ± 1.5
					250 Hz	84.9	-8.6 ± 1.4
					500 Hz	90.3	-3.2 ± 1.4
					1 kHz	93.6	Ref.
					2 kHz	94.9	$+1.2 \pm 1.6$
					4 kHz	94.8	$+1.0 \pm 1.6$
					8 kHz	92.6	-1.1 (+2.1;-3.1)
					12.5 kHz	89.7	-4.3 (+3.0 ; -6.0)

6.3.2 C-Weighting

		T Setting		Appl	ied Value	UUT	IEC 61672 Class 1
Range	Mode	Frequency	Time	Level	Freq.	Reading	Spec.
(dB)		Weighting	Weighting	(dB)		(dB)	(dB)
30 - 120	L _C	С	Fast	94.00	63 Hz	92.7	-0.8 ± 1.5
					125 Hz	93.4	-0.2 ± 1.5
					250 Hz	93.6	0.0 ± 1.4
					500 Hz	93.7	0.0 ± 1.4
					1 kHz	93.7	Ref.
					2 kHz	93.5	-0.2 ± 1.6
					4 kHz	93.0	-0.8 ± 1.6
					8 kHz	90.7	-3.0 (+2.1;-3.1)
					12.5 kHz	87.9	-6.2 (+3.0 ; -6.0)

Remarks : - UUT Microphone Model No. : UC-53A & S/N : 307154

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value : 94 dB	: 63 Hz - 125 Hz : ± 0.35 dB 250 Hz - 500 Hz : ± 0.30 dB
	1 kHz : $\pm 0.20 \text{ dB}$
	$2 \text{ kHz} - 4 \text{ kHz}$: $\pm 0.35 \text{ dB}$
	8 kHz : $\pm 0.45 \text{ dB}$
	12.5 kHz : $\pm 0.70 \text{ dB}$
104 d	B : 1 kHz : \pm 0.10 dB (Ref. 94 dB)
114 d	B : 1 kHz : $\pm 0.10 \text{ dB}$ (Ref. 94 dB)

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.



Certificate No. : C134306 證書編號

ITEM TESTED / 送檢項目		(Job No. / 序引編號:IC13-1709)
Description / 儀器名稱	:	Sound Level Calibrator
Manufacturer / 製造商	:	Rion
Model No. / 型號	:	NC-73
Serial No. / 編號	:	10786708
Supplied By / 委託者	:	Envirotech Services Co.
		Shop 6, G/F., Casio Mansion, 209 Shaukeiwan Road,
		Hong Kong

TEST CONDITIONS / 測試條件

Temperature / 溫度 : (23 ± 2)°C Line Voltage / 電壓 : --- Relative Humidity / 相對濕度 : (55 ± 20)%

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 12 July 2013

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only. All results are within manufacturer's specification. The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Rohde & Schwarz Laboratory, Germany
- Fluke Everett Service Center, USA
- Agilent Technologies, USA

Tested By 測試	:	K C Lee			
Certified By 核證	(K M Wu	Date of Issue 簽發日期	:	15 July 2013

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Calibration and Testing Laboratory

Certificate of Calibration 校正證書

Certificate No.: C134306 證書編號

- 1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.
- 2. The results presented are the mean of 3 measurements at each calibration point.
- 3. Test equipment :

Equipment ID CL130 CL281 TST150A <u>Description</u> Universal Counter Multifunction Acoustic Calibrator Measuring Amplifier <u>Certificate No.</u> C133632 DC130171 C120886

- 4. Test procedure : MA100N.
- 5. Results :
- 5.1 Sound Level Accuracy

UUT	Measured Value	Mfr's Spec.	Uncertainty of Measured Value
Nominal Value	(dB)	(dB)	(dB)
94 dB, 1 kHz	93.8	± 0.5	± 0.2

5.2 Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's	Uncertainty of Measured Value
(kHz)	(kHz)	Spec.	(Hz)
1	0.990	1 kHz ± 2 %	± 1

Remark : The uncertainties are for a confidence probability of not less than 95 %.

Note :

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to the Nation Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Annex F

Event/Action Plans for Noise

Annex F Event and Action Plan for Noise

Event				Ac	tion			
	En	vironmental Team (ET)	Independent Environmental Checker (IEC)		A	uthorised Person (AP)	Contractor	
Action Level	1. 2. 3. 4. 5.	Notify IEC and Contractor; Carry out investigation; Report the results of investigation to the IEC, AP and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness.	 1. 2. 3. 	Review the analysed results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the AP accordingly; Supervise the implementation of remedial measures.	 1. 2. 3. 4. 	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to proposed remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented.	1. 2.	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.
Limit Level	 1. 2. 3. 4. 5. 6. 7. 8. 	Identify source; Inform IEC and AP; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, AP and EPD the causes and actions taken for the exceedances; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and AP informed of the results; If exceedance stops, cease additional monitoring.		Discuss amongst AP, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the AP accordingly; Supervise the implementation of remedial measures.	 1. 2. 3. 4. 5. 	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.	 1. 2. 3. 4. 5. 	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the AP until the exceedance is abated.

Annex G

Summary of Implementation Status

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
Cultur	al Heritag	ge			
S3.9.1	S3.2.6	Subject to the outcome of the archaeological investigation, if archaeological deposits are identified to be impacted by the proposed development, appropriate mitigation measures will be recommended and agreed with AMO.	In accordance with the recommendations in the Archaeological Action Plan (AAP) issued on 21 Dec 11 and approved on 30 Dec 11 by AMO	During detailed design and construction	No field work in the reporting month.
S3.9.2	S3.3.1	<u>Vibration Monitoring</u> A baseline condition survey and baseline vibration impact will be conducted by a specialist for the approval of AMO and Buildings Department prior to commencement of the construction works to define the vibration control limits and recommend a vibration monitoring proposal for the concerned historic buildings and structures in and outside CPS for AMO's prior approval before commencement of the construction works.	Historic buildings and structures in CPS, the granite walls at Old Bailey Street and the proposed Grade 3 historic building (No. 20 Hollywood Road)	During detailed design and construction	\checkmark
\$3.9.2	S3.3.3	<u>Compliance of the Approved Measures and Auditing</u> Staff training by an experience building conservation expert or relevant competent person(s) in the environmental team of the project should be provided to the on-site staffs, contractors, sub-contractors and workers of the project before commencement of works to ensure their full understanding of the approved protection schedule, restoration proposal and work methodologies related to cultural heritage, and their respective responsibilities in the implementation of the environmental protection measures. Regular site audit for cultural heritage should be carried out in the construction phase by an experience building conservation expert in the environmental team ("the Heritage Checker") to investigate the site practice of the contractors and workers and their compliance of the approved work methodologies with respect of conservation works, mitigations for cultural heritage and any related works. A detailed	Whole site	Prior to and during construction	\checkmark

Annex G Implementation Schedule for Environmental Protection Measures (1 August to 31 August 2013)

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		proposal of the regular audit such as methodology (e.g. performance and monitoring indicators, control tools, frequency of the audit, etc.) and the conservation professionals to be engaged should be agreed with AMO prior to work commencement. The Heritage Checker shall also attend the regular site meetings with AMO and report the compliance and effectiveness of the mitigation measures for cultural heritage.			
53.9.3	S3.3.4	<u>Archival Recording</u> An archival recording should be conducted to provide a detailed reference for the update of the Conservation Management Plan and inventory of historical features of the monuments, the preparation of as- built drawings showing the condition of the historic buildings and structures after the completion of the construction works. These archival records will be a reference source for future maintenance of the character defining elements, conservation of the monuments, interpretation and conservation education of the Site. The archival recording shall include but not limit to the video and photographic recording on the detailed process of the repair trials for different kinds of historical features, conservation works of character defining elements and historic fabrics of the monuments, and a written records of any new changes to the detailed design made in the construction phase illustrate with photos and drawings. A full set of the archives records (including both hard and soft copies) should be submitted to the AMO for approval after the work completion for record purpose. Any new findings related to the conservation of built heritage in the Site identified during the detailed design stage and construction phases shall be properly recorded in details for notification to the AMO and update of the Conservation Management Plan.	Whole Site	During detailed design, construction and prior to operation	N/A – Archival recording will be conducted at later stage.
S3.7.3	-	<u>General Construction Methods</u> Prior to the commencement of the modification/refurbishment works at an existing building or structure (e.g. masonry walls near the Old Bailey Wing), a site survey will be carried out by the design team, and all building dimensions and levels of the building/structure shown will be	Whole site	During construction	7

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
53.7.1 & 3.7.2	-	checked and confirmed by the contractor. Non-percussive piling methods will be adopted for the construction of the foundation for the new buildings. Protective and precaution measures to the existing buildings and structure adjacent to the work area (including the proposed Grade 3 historic building (No. 20 Hollywood road) and the granite boundary walls between the Ablutions Block of the police station (building no. 08) and the General Office of the prison area (building no. 18) which is adjacent to the new construction of the Old Bailey Wing and for an old granite walls at Old Bailey Street within 15m from the new construction) shall be provided to avoid damage to the existing features and to safeguard the structural integrity during the course of construction. Small scale handheld pneumatic tools with minimal vibration impact to the existing buildings/ structures are selected so as to have a better logistic and handling at the existing buildings and structures, which usually have only narrow working areas. In cases of the local demolition of structural elements, demountable platforms will be erected to temporarily support the affected area and divert the loading from above to avoid instability and create excessive cracking and settlement of the building/structure. Implementation and update of the Conservation Management Plan (CMP). Any new findings related to the conservation of the built heritage in the site identified during the detailed design and construction stage shall be properly recorded in details for the notification to the AMO and update in the CMP. After the construction, a cartographic and photographic recording on the restored historic buildings, historic features and the site shall be conducted and the following records shall be included into the CMP as appendices for updating and record purpose: • one set of measured drawings and photographic records showing the as-built condition of historic buildings and structures; and • an updated inventory list of the historic features together with the cr	Whole site	During detailed design, construction, post- construction and operation	√ - CMP was implemented during the reporting month. There were no updates for the CMP.

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
Landsca	ipe & Visi	ıal			
S4.7.27		<u>In-situ Tree Protection - Cordon Zone (CZ)</u> Cordon off each tree along its drip line (below the crown) with a chain- link fencing of 2.5 m height with padlocked gate, allowing limited access to area only to authorized persons. The base of the perimeter fence will be sealed up to 30 cm height to ensure that no construction drainage water will enter. If grouting is to be conducted less than 5 m from the edge of the CZ, a waterproof membrane will be installed below the ground to a depth of 1.5 m on the outer edge of the CZ to prevent the subsurface lateral movement of contaminated construction wastewater from intruding the soil inside the CZ.	Whole site	During construction	 √ - Part of the cordon zone of Tree-5 has been used as a worker storage room. The Contractor was recommended to pay utmost attention to potential land pollution at the worker storage room at all times. Scaffolding has been set up close to Tree-5 within the cordon zone. The Contractor was reminded to perform proper measures to protect Tree-5 during the carrying out of works within the cordon zone.
S4.7.2	-	In-situ Tree Protection - Advanced & Phased Root Pruning All edges of the CZ that will be affected by excavation will undergo root pruning by a trained arborist or horticulturist, in advance of the earth work. The entire affected length of the CZ, plus 3 m additional length at both ends, shall be designated as the root pruning segment (RPS). The require trench will be opened manually in the RPS, be 1.5 m deep and 1 m wide, and closed on the same day after pruning with a good soil mix. All roots with a diameter >20 mm encountered in the course of trench opening shall be cut flushed with the inner wall of the trench. If the RPS exceeds one-quarter of the CZ circumference, the root pruning should be conducted in two stages. Each phase will tackle half of the RPS length. After the first phase, the tree will be allowed to recuperate for not less than four months before the second phase root pruning is conducted. The RPS shall be protected by sheet piles along the outer edge. The rig that installs the piles and the associated operations shall not intrude into the CZ or injure the protected tree.	Whole site	During construction	N/A – no root pruning has been conducted yet
S4.7.2	-	<u>In-situ Tree Protection - Foliage cleansing system</u> A sprinkler cleansing system will be installed either in the crown of the tree or at a suitable location on an adjacent building to provide the	Whole site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		means to wash the foliage of the accumulated dust when necessary,			
		particularly in the dry season.			
S4.7.2	S4	In-situ Tree Protection - Monthly inspection	Whole site	During construction	\checkmark
		Monthly inspection of affected trees by an experienced and appropriately trained arborist or horticulturist using Form 1 – Tree Group Inspection Form and Form 2 – Tree Risk Assessment Form developed by Development Bureau (<i>http://www.trees.gov.hk/en/doc/TRAGuideline_July2010version_combine.pdf</i>) or a form designed by a tree expert and approved by Tree Management Office. All irregularities that deviate from the recommended tree protection measures, or could impose deleterious impacts on the protected trees, must be reported to the authorized person or the tree expert within two days.			
S4.7.2	-	<u>Light Control</u> Control of night-time lighting shall be implemented to minimise impact to adjacent VSRs.	Whole site	During construction and operation	\checkmark
S4.7.2	S4	<u>Compensatory Tree Planting</u> A new planting site has been identified for compensatory tree planting in the Parade Ground. The planting is to compensate for felling of T10. The existing tree site will be enlarged to become a wide tree strip to accommodate at least six trees. The entire strip of land that accommodates T1 to T4 should be revamped to improve the soil condition for future tree growth. The new tree strip should be 4 m wide and covered by porous unit pavers to permit the entry of rain and irrigation water and air exchange between the soil and the atmosphere. The unit pavers should be supported by small columns to create a vault-like structure so as to avoid compaction of the underlying soil due to pedestrian trampling. The unit pavers will be movable to provide access to the soil underneath so that fertilizers and conditioners could be added on a	At identified compensatory tree planting location at the Parade Ground	During detailed design and construction	N/A – Compensatory Tree Planting will be conducted at later stage.

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		regular basis. The air conditioner unit currently located near the proposed planting site should also be removed. This new tree planting site should also be provided with proper irrigation.			
		Pursuant to the "Environment, Transport and Works Bureau Technical Circular (Works) No. 3/2006 Tree Preservation", the compensation ratio should preferably be 1:1 according to trunk girth. T10 has a DBH of 20 cm (<i>Table 4.3</i>), and it is proposed that six trees of heavy standard size be planted, each with a DBH of around 10 cm and root balls of not less than 0.75 m diameter and 0.75 m depth,. Since the aggregate DBH of the new trees would be 60 cm, the rate of compensation is equivalent to three times the DBH of T10, far beyond the requirements			
		The six replacement trees should be planted in the new tree strip in two staggered rows, maximising distance between each tree to avoid mutual interference in the future. It is recommended that the species selected should have a small final dimension of less than 10 m height given the proximity to built structures such as the retaining wall and buildings. Two each of the outstanding and related flowering tree species connected to local natural history are suggested::			
		 Bauhinia 'Blakeana' a native evergreen species with deep mauve flowers and an exceptionally long flowering period from late autumn to early spring. 			
		 Bauhinia purpure, a native evergreen with lighter purple flowers from late autumn to early winter. 			
		 Bauhinia variegata, an exotic deciduous species, with pale pinkish flowers in spring to early summer often when the tree has little or no leaves. 			
S4.7.2	S4	<u>Vertical Greening</u> Within the limitations of the conservation of the CPS character,	Inner Southern Wall	During detailed design and construction	N/A – No vertical greening was conducted during the reporting month.
		greening of vertical structures should be provided where possible. As such it is recommended that the inner southern wall of the Site be planted as a green wall. The plantings should be inserted in between each of the large protruding piers and an offset be made from both the			

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		top and bottom edge so that old and new are equally visible. An independent frame should be strategically positioned in order to ensure minimal disturbance to the original wall, and provide the main structural support and planting surface for the green wall. The frame on to which the new green will be planted should contain its own irrigation system so that moisture for the plants will remain mainly on the planting surface and not the exiting wall behind. The planting chosen should be appropriate to the Hong Kong climate, requiring relatively little maintenance to sustain the quality of both plants and wall.			
S4.7.2	-	<i>New Custom Paving</i> New, Patterned, High Quality, Concrete Custom Pavers should replace most of the existing paving in the open spaces.	Whole site	During detailed design and construction	N/A – No custom paving was conducted during the reporting month.
S4.7.2	S4	<u>In-situ Tree Protection - Quarterly inspection</u> Quarterly Inspection of affected and newly planted trees by an experienced and appropriately trained arborist or horticulturist using Form 1 – Tree Group Inspection Form and Form 2 – Tree Risk Assessment Form developed by Development Bureau (http://www.trees.gov.hk/en/doc/TRAGuideline_July2010version_combine.pdf) or a form designed by a tree expert and approved by Tree Management Office for a period of 12 months after construction.	Whole site	During post construction and operation	N/A – The quarterly inspection will be conducted at later stage.
Noise				•	
<i>S5.9</i>	-	 The following site practices should be followed during the construction of the Project: Only well-maintained plant will be operated on-site and plant will be serviced regularly during the construction phase; Silencers or mufflers on construction equipment will be utilised and will be properly maintained during the construction phase; Mobile plant, if any, will be sited as far away from NSRs as possible; 	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		 Machines and plant (such as trucks) that may be in intermittent use will be shut down between work periods or will be throttled down to a minimum; Plant known to emit noise strongly in one direction will, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and Material stockpiles and other structures will be effectively utilised, wherever practicable, in screening noise from on-site construction activities. 			
\$5.9	-	Noise insulating sheet would be adopted for certain PME (eg drill rig, excavator for demolition of existing structures, etc). The noise insulating sheet should be deployed such that there would be no opening or gaps on the joints.	Whole Site	During construction	V
<i>S5.9</i>	-	Use temporary noise barriers to mitigate the noise impact arising from the construction works, particularly for low-rise NSRs. Movable noise barriers of 3 m in height with skid footing should be used and located within a few metres of stationary plant and mobile plant such that the line of sight to the NSR is blocked by the barriers. The length of the barrier should be at least five times greater than its height. The noise barrier material should have a superficial surface density of at least 7 kg m ⁻² and have no openings or gaps.	Whole Site	During construction	V
<i>S5.9</i>	-	Use quiet PME as far as practicable to mitigate the construction noise impact.	Whole Site	During construction	V
<i>S5.9</i>	-	Scheduling of construction activities with identified grouping of PMEs.	Whole Site	During construction	V
S5.11	S5	Weekly noise monitoring will be undertaken at the representative NSRs N2 Ho Fook Building and N5 Chancery House. Monthly site audits will be conducted to ensure that the recommended mitigation measures are properly implemented during the construction stage.	Whole Site	During construction	V
Air Qu	ality				
S6.8.1	-	Dust control measures stipulated in the <i>Air Pollution Control</i> (<i>Construction Dust</i>) <i>Regulation</i> will be implemented during the construction phase to control the potential fugitive dust emissions.	Whole Site	During - construction	V

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S6.8.1	-	In particular: Temporary stockpiles of dusty materials will be either covered entirely by impervious sheets; placed in an area sheltered on the top and three sides; or sprayed with water to maintain the entire surface wet at all the time.	Whole Site	During construction	\checkmark
S6.8.1	-	Impervious sheet will be provided for skip hoist for material transport.	Whole Site	During construction	\checkmark
S6.8.1	-	Vehicle washing facilities will be provided at the designated vehicle exit points.	Whole Site	During construction	\checkmark
S6.8.1	-	Every vehicle will be washed to remove any dusty materials from its chassis and wheels immediately before leaving the worksite.	Whole Site	During construction	\checkmark
S6.8.1	-	Road sections between vehicle-wash areas and vehicular entrances will be paved.	Whole Site	During construction	\checkmark
S6.8.1	-	The load carried by the trucks will be covered entirely to ensure no dust emission from the vehicles.	Whole Site	During construction	\checkmark
S6.8.1	-	Hoarding of not less than 2.4m high from ground level will be provided along the Project Site boundary adjoining a road where the new buildings (Old Bailey Wing and Arbuthnot Wing) will be constructed.	Whole Site	During construction	\checkmark
S6.8.1	-	Stockpiles of more than 20 bags of cement, dry pulverised fuel ash and dusty construction materials will be covered entirely by impervious sheeting sheltered on top and 3-sides.	Whole Site	During construction	\checkmark
S6.8.1	-	An effective dust screen will be provided to enclose scaffolding, if required, from the ground floor level of building for construction of superstructure of the new buildings.	Whole Site	During construction	\checkmark
S6.8.1	-	Impervious dust screen or sheeting will be implemented for demolition of structures and renovation of outer surfaces of structures that abuts or fronts open area accessible to the public to no less than 1m higher than the highest level of the structure being demolished.	Whole Site	During construction	\checkmark
S6.8.1	-	The area at which demolition work takes place will be sprayed with water or dust suppression chemical immediately prior to, during and immediately after the demolition activity.	Area for Demolition Work	During construction	√

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S6.8.1	-	ULSD will be used for all construction plant on-site.	Whole Site	During construction	\checkmark
S6.8.1	-	The engine of the construction equipment or trucks during idling will be switched off.	Whole Site	During construction	\checkmark
S6.8.1	-	Site practices such as regular maintenance and checking of construction equipment deployed on-site will be conducted to avoid any black smoke emissions and to minimise gaseous emissions.	Whole Site	During construction	N/A – Not observed.
S6.10	S3.2	Monthly environmental site audits to ensure that appropriate dust control measures are properly implemented and good construction site practices are adopted throughout the construction period.	Whole Site	During construction	\checkmark
Water (Quality		I		1
S7.6	-	Channels, earth bunds or sand bag barriers will be provided on site to direct stormwater to silt removal facilities. The design of silt removal facilities will make reference to the guidelines in <i>Appendix A1</i> of <i>ProPECC PN 1/94</i> . All drainage facilities and erosion and sediment control structures will be inspected on a regular basis and maintained to confirm proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit will be removed regularly.	Whole Site	During construction	V
S7.6	-	All drainage facilities and erosion and sediment control structures will be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit will be removed regularly and disposed of.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Measures will be taken to reduce the ingress of stormwater into excavation areas. If the excavation of the concrete foundation is to be carried out in wet season, they will be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations will be discharged into stormwater drains via silt removal facilities.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Open stockpiles of excavated and demolition materials will be covered with tarpaulin or similar fabric during rainstorms. Measures will be taken to prevent the washing away of residues, chemicals or debris into any drainage system.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S7.6	-	Manholes (including newly constructed ones) will always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Precautions will be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarised in Appendix A2 of <i>ProPECC PN 1/94</i> . Particular attention will be paid to the control of silty surface runoff during storm events.	Whole Site	During construction	N/A – Not observed.
S7.6	-	All temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge will be adequately designed for the controlled release of stormwater flows. All sediment traps will be regularly cleaned and maintained. The temporary diverted drainage will be reinstated to the original condition when the construction work has finished or the temporary diversion is no longer required.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Vehicle and plant servicing areas, vehicle washing bays and lubrication bays will, as far as possible, be located within roofed areas. The drainage in these covered areas will be connected to foul sewers via a petrol interceptor.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Oil leakage or spillage will be contained and cleaned up immediately. Waste oil will be collected and stored for recycling or disposal.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Waste streams classifiable as chemical wastes will be properly stored, collected and treated.	Whole Site	During construction	\checkmark
S7.6	-	All fuel tanks and chemical storage areas will be provided with locks and be sited on paved areas.	Whole Site	During construction	\checkmark
S7.6	-	The storage areas will be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled oil, fuel and chemicals from reaching the receiving waters.	Whole Site	During construction	\checkmark
S7.6	-	The Contractors will prepare guidelines and procedures for immediate clean-up actions following any spillages of oil, fuel or chemicals.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S7.6	-	Surface runoff from bunded areas will pass through oil/grease traps prior to discharge to the stormwater system	Whole Site	During construction	N/A – Not observed.
S7.6	-	The stormwater discharge from the site will be monitored as part of the routine monitoring under the WPCO licence, if applicable.	Whole Site	During construction	N/A – Not observed.
S7.6	-	The existing toilet facilities of the CPS will be available to the construction workforce. The sewage will be discharged to the public sewer.	Whole Site	During construction	\checkmark
S7.8	S5.2	Monthly site audits of the works areas will be carried out during the construction phase to monitor the environmental performance of the Project and to enable prompt actions to rectify any malpractice which may give rise to water pollution problem.	Whole Site	During construction	N
Waste I	Manageme	nt			
S8.5	S6.3.1 & Table 6.1	<u>General</u> The Contractor shall apply for and obtain all the necessary waste disposal permits or licences are obtained prior to the commencement of the construction works.	Whole Site	During construction	\checkmark
S8.5	-	<u>Management of Waste Disposal</u> The construction contractor will open a billing account with the EPD. Every construction waste or public fill load to be transferred to the Government waste disposal facilities such as public fill reception facilities, sorting facilities, landfills will require a valid "chit" which contains the information of the account holder to facilitate waste transaction recording and billing to the waste producer.	Whole Site	During construction	√
S8.5	S6.2	A trip-ticket system will also be established to monitor the disposal of construction waste at landfill and to control fly-tipping. The trip-ticket system will be included as one of the contractual requirements and implemented by the contractor.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S8.5	S6 & Table 6.1	A recording system for the amount of wastes generated/recycled and disposed of will be established during the construction phase.	Whole Site	During construction	\checkmark
S8.5	S6.3	<u>Reduction of Construction Waste Generation</u> C&D material will be segregated on-site into public fill and construction waste and stored in different containers or skips to facilitate reuse of the public fill and proper disposal of the construction waste. Specific areas of the work site will be designated for such segregation and storage if immediate use is not practicable.	Whole Site	During construction	\checkmark
S8.5	S6	<u>Chemical Waste</u> The contractor will register as a chemical waste producer with the EPD.	Whole Site	During construction and operation	\checkmark
S8.5	S6	 Containers used for storage of chemical waste shall: Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and Display a label in English and Chinese in accordance with instructions prescribed in <i>Schedule 2</i> of the <i>Regulations</i>. 	Whole Site	During construction and operation	\checkmark
S8.5	S6	 Storage areas for chemical waste shall: Be clearly labelled and used solely for the storage of chemical waste; Be enclosed on at least 3 sides; Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; Have adequate ventilation; Be covered to prevent rainfall entering (water collected within the bund must be tested and disposed of as chemical waste, if necessary); and Be arranged so that incompatible materials are appropriately separated. 	Whole Site	During construction and operation	V

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S8.5	S6	A licensed contractor shall be employed to collect chemical waste for delivery to a licensed treatment facility.	Chemical Waste Treatment Centre at Tsing Yi	During construction and operation	\checkmark
S8.5	S6 & Table 6.1	<u>General Refuse</u> General refuse will be stored in enclosed bins separately from construction and chemical wastes. The general refuse will be delivered to the transfer station, separately from construction and chemical wastes, on a daily basis to reduce odour, pest and litter impacts.	Whole site	During construction	\checkmark
S8.5	S6	Recycling bins will be provided at strategic locations to facilitate recovery of aluminium can and waste paper from the Site. Materials recovered will be sold for recycling.	Whole site	During construction and operation	\checkmark
S8.5	S6	<u>Staff Training</u> At the commencement of the construction works, training will be provided to workers on the concepts of site cleanliness and on appropriate waste management procedures, including waste reduction, reuse and recycling.	Whole site	Commencement of construction	\checkmark
S8.7	S6.1 & 6.3	Monthly audits of the waste management practices will be carried out during the construction phases to determine if wastes are being managed in accordance with the recommended good site practices. The audits will examine all aspects of waste management including waste generation, storage, recycling, transport and disposal.	Whole site	During construction	√

Remark:

 $\sqrt{}$ Compliance of Mitigation Measures

<> Compliance of Mitigation but need improvement

x Non-compliance of Mitigation Measures

▲ Non-compliance of Mitigation Measures but rectified by Gammon Construction Ltd

Δ Deficiency of Mitigation Measures but rectified by Gammon Construction Ltd

N/A Not Applicable in Reporting Period

Annex G	Implementation Schedule	for Environmental Protect	tion Measures (1 September	to 30 September 2013)

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
Cultur	al Heritag	ge			
S3.9.1	S3.2.6	Subject to the outcome of the archaeological investigation, if archaeological deposits are identified to be impacted by the proposed development, appropriate mitigation measures will be recommended and agreed with AMO.	In accordance with the recommendations in the Archaeological Action Plan (AAP) issued on 21 Dec 11 and approved on 30 Dec 11 by AMO	During detailed design and construction	No field work in the reporting month.
S3.9.2	S3.3.1	<u>Vibration Monitoring</u> A baseline condition survey and baseline vibration impact will be conducted by a specialist for the approval of AMO and Buildings Department prior to commencement of the construction works to define the vibration control limits and recommend a vibration monitoring proposal for the concerned historic buildings and structures in and outside CPS for AMO's prior approval before commencement of the construction works.	Historic buildings and structures in CPS, the granite walls at Old Bailey Street and the proposed Grade 3 historic building (No. 20 Hollywood Road)	During detailed design and construction	1
53.9.2	S3.3.3	<u>Compliance of the Approved Measures and Auditing</u> Staff training by an experience building conservation expert or relevant competent person(s) in the environmental team of the project should be provided to the on-site staffs, contractors, sub-contractors and workers of the project before commencement of works to ensure their full understanding of the approved protection schedule, restoration proposal and work methodologies related to cultural heritage, and their respective responsibilities in the implementation of the environmental protection measures. Regular site audit for cultural heritage should be carried out in the construction phase by an experience building conservation expert in the environmental team ("the Heritage Checker") to investigate the site practice of the contractors and workers and their compliance of the approved work methodologies with respect of conservation works, mitigations for cultural heritage and any related works. A detailed	Whole site	Prior to and during construction	

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		proposal of the regular audit such as methodology (e.g. performance and monitoring indicators, control tools, frequency of the audit, etc.) and the conservation professionals to be engaged should be agreed with AMO prior to work commencement. The Heritage Checker shall also attend the regular site meetings with			
		AMO and report the compliance and effectiveness of the mitigation measures for cultural heritage.			
S3.9.3	S3.3.4	<u>Archival Recording</u> An archival recording should be conducted to provide a detailed reference for the update of the Conservation Management Plan and inventory of historical features of the monuments, the preparation of as- built drawings showing the condition of the historic buildings and structures after the completion of the construction works. These archival records will be a reference source for future maintenance of the character defining elements, conservation of the monuments, interpretation and conservation education of the Site. The archival recording shall include but not limit to the video and photographic recording on the detailed process of the repair trials for different kinds of historical features, conservation works of character defining elements and historic fabrics of the monuments, and a written records of any new changes to the detailed design made in the construction phase illustrate with photos and drawings. A full set of the archives records (including both hard and soft copies) should be submitted to the AMO for approval after the work completion for record purpose. Any new findings related to the conservation of built heritage in the Site identified during the detailed design stage and construction phases shall be properly recorded in details for notification to the AMO and update of the Conservation Management Plan.	Whole Site	During detailed design, construction and prior to operation	N/A – Archival recording will be conducted at later stage.
S3.7.3	-	<u>General Construction Methods</u> Prior to the commencement of the modification/refurbishment works at an existing building or structure (e.g. masonry walls near the Old Bailey	Whole site	During construction	\checkmark
		Wing), a site survey will be carried out by the design team, and all building dimensions and levels of the building/structure shown will be			

EIA EM&A Ref. Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S3.7.1 - & 3.7.2	 checked and confirmed by the contractor. Non-percussive piling methods will be adopted for the construction of the foundation for the new buildings. Protective and precaution measures to the existing buildings and structure adjacent to the work area (including the proposed Grade 3 historic building (No. 20 Hollywood road) and the granite boundary walls between the Ablutions Block of the police station (building no. 08) and the General Office of the prison area (building no. 18) which is adjacent to the new construction of the Old Bailey Wing and for an old granite walls at Old Bailey Street within 15m from the new construction) shall be provided to avoid damage to the existing features and to safeguard the structural integrity during the course of construction. Small scale handheld pneumatic tools with minimal vibration impact to the existing buildings / structures are selected so as to have a better logistic and handling at the existing buildings and structures, which usually have only narrow working areas. In cases of the local demolition of structural elements, demountable platforms will be erected to temporarily support the affected area and divert the loading from above to avoid instability and create excessive cracking and settlement of the building/structure. Implementation and update of the Conservation Management Plan (CMP). Any new findings related to the conservation of the built heritage in the site identified during the detailed design and construction, a cartographic and photographic recording on the restored historic buildings, historic features and the site shall be conducted and the following records shall be included into the CMP as appendices for updating and record purpose: one set of measured drawings and photographic records showing the as-built condition of historic buildings and structures; and an updated inventory list of the historic features together with the cross referenced location plans and photo records. 	Whole site	During detailed design, construction, post- construction and operation	√ - CMP was implemented during the reporting month. There were no updates for the CMP.

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
Landsca	ipe & Visi	ıal			1
S4.7.27	-	<u>In-situ Tree Protection - Cordon Zone (CZ)</u> Cordon off each tree along its drip line (below the crown) with a chain- link fencing of 2.5 m height with padlocked gate, allowing limited access to area only to authorized persons. The base of the perimeter fence will be sealed up to 30 cm height to ensure that no construction drainage water will enter. If grouting is to be conducted less than 5 m from the edge of the CZ, a waterproof membrane will be installed below the ground to a depth of 1.5 m on the outer edge of the CZ to prevent the subsurface lateral movement of contaminated construction wastewater from intruding the soil inside the CZ.	Whole site	During construction	 √ - Part of the cordon zone of Tree-5 has been used as a worker storage room. The Contractor was recommended to pay utmost attention to potential land pollution at the worker storage room at all times. Scaffolding has been set up close to Tree-5 within the cordon zone. The Contractor was reminded to perform proper measures to protect Tree-5 during the carrying out of works within the cordon zone.
S4.7.2	-	<u>In-situ Tree Protection - Advanced & Phased Root Pruning</u> All edges of the CZ that will be affected by excavation will undergo root pruning by a trained arborist or horticulturist, in advance of the earth work. The entire affected length of the CZ, plus 3 m additional length at both ends, shall be designated as the root pruning segment (RPS). The require trench will be opened manually in the RPS, be 1.5 m deep and 1 m wide, and closed on the same day after pruning with a good soil mix. All roots with a diameter >20 mm encountered in the course of trench opening shall be cut flushed with the inner wall of the trench. If the RPS exceeds one-quarter of the CZ circumference, the root pruning should be conducted in two stages. Each phase will tackle half of the RPS length. After the first phase, the tree will be allowed to recuperate for not less than four months before the second phase root pruning is conducted. The RPS shall be protected by sheet piles along the outer edge. The rig that installs the piles and the associated operations shall not intrude into the CZ or injure the protected tree.	Whole site	During construction	N/A – no root pruning has been conducted yet
S4.7.2	-	<u>In-situ Tree Protection - Foliage cleansing system</u> A sprinkler cleansing system will be installed either in the crown of the tree or at a suitable location on an adjacent building to provide the	Whole site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		means to wash the foliage of the accumulated dust when necessary,			
		particularly in the dry season.			
S4.7.2	S4	In-situ Tree Protection - Monthly inspection	Whole site	During construction	\checkmark
		Monthly inspection of affected trees by an experienced and appropriately trained arborist or horticulturist using Form 1 – Tree Group Inspection Form and Form 2 – Tree Risk Assessment Form developed by Development Bureau (<i>http://www.trees.gov.hk/en/doc/TRAGuideline_July2010version_combine.pdf</i>) or a form designed by a tree expert and approved by Tree Management Office. All irregularities that deviate from the recommended tree protection measures, or could impose deleterious impacts on the protected trees, must be reported to the authorized person or the tree expert within two days.			
S4.7.2	-	<u>Light Control</u> Control of night-time lighting shall be implemented to minimise impact to adjacent VSRs.	Whole site	During construction and operation	\checkmark
S4.7.2	S4	<u>Compensatory Tree Planting</u> A new planting site has been identified for compensatory tree planting in the Parade Ground. The planting is to compensate for felling of T10. The existing tree site will be enlarged to become a wide tree strip to accommodate at least six trees. The entire strip of land that accommodates T1 to T4 should be revamped to improve the soil condition for future tree growth. The new tree strip should be 4 m wide and covered by porous unit pavers to permit the entry of rain and irrigation water and air exchange between the soil and the atmosphere. The unit pavers should be supported by small columns to create a vault-like structure so as to avoid compaction of the underlying soil due to pedestrian trampling. The unit pavers will be movable to provide access to the soil underneath so that fertilizers and conditioners could be added on a	At identified compensatory tree planting location at the Parade Ground	During detailed design and construction	N/A – Compensatory Tree Planting will be conducted at later stage.

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		regular basis. The air conditioner unit currently located near the proposed planting site should also be removed. This new tree planting site should also be provided with proper irrigation.			
		Pursuant to the "Environment, Transport and Works Bureau Technical Circular (Works) No. 3/2006 Tree Preservation", the compensation ratio should preferably be 1:1 according to trunk girth. T10 has a DBH of 20 cm (<i>Table 4.3</i>), and it is proposed that six trees of heavy standard size be planted, each with a DBH of around 10 cm and root balls of not less than 0.75 m diameter and 0.75 m depth,. Since the aggregate DBH of the new trees would be 60 cm, the rate of compensation is equivalent to three times the DBH of T10, far beyond the requirements			
		The six replacement trees should be planted in the new tree strip in two staggered rows, maximising distance between each tree to avoid mutual interference in the future. It is recommended that the species selected should have a small final dimension of less than 10 m height given the proximity to built structures such as the retaining wall and buildings. Two each of the outstanding and related flowering tree species connected to local natural history are suggested::			
		 Bauhinia 'Blakeana' a native evergreen species with deep mauve flowers and an exceptionally long flowering period from late autumn to early spring. 			
		 Bauhinia purpure, a native evergreen with lighter purple flowers from late autumn to early winter. 			
		 Bauhinia variegata, an exotic deciduous species, with pale pinkish flowers in spring to early summer often when the tree has little or no leaves. 			
S4.7.2	S4	<u>Vertical Greening</u> Within the limitations of the conservation of the CPS character,	Inner Southern Wall	During detailed design and construction	N/A – No vertical greening was conducted during the reporting month.
		greening of vertical structures should be provided where possible. As such it is recommended that the inner southern wall of the Site be planted as a green wall. The plantings should be inserted in between each of the large protruding piers and an offset be made from both the			

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		top and bottom edge so that old and new are equally visible. An independent frame should be strategically positioned in order to ensure minimal disturbance to the original wall, and provide the main structural support and planting surface for the green wall. The frame on to which the new green will be planted should contain its own irrigation system so that moisture for the plants will remain mainly on the planting surface and not the exiting wall behind. The planting chosen should be appropriate to the Hong Kong climate, requiring relatively little maintenance to sustain the quality of both plants and wall.			
S4.7.2	-	<i>New Custom Paving</i> New, Patterned, High Quality, Concrete Custom Pavers should replace most of the existing paving in the open spaces.	Whole site	During detailed design and construction	N/A – No custom paving was conducted during the reporting month.
S4.7.2	S4	<u>In-situ Tree Protection - Quarterly inspection</u> Quarterly Inspection of affected and newly planted trees by an experienced and appropriately trained arborist or horticulturist using Form 1 – Tree Group Inspection Form and Form 2 – Tree Risk Assessment Form developed by Development Bureau (http://www.trees.gov.hk/en/doc/TRAGuideline_July2010version_combine.pdf) or a form designed by a tree expert and approved by Tree Management Office for a period of 12 months after construction.	Whole site	During post construction and operation	N/A – The quarterly inspection will be conducted at later stage.
Noise					
<i>S</i> 5.9	-	 The following site practices should be followed during the construction of the Project: Only well-maintained plant will be operated on-site and plant will be serviced regularly during the construction phase; Silencers or mufflers on construction equipment will be utilised and will be properly maintained during the construction phase; Mobile plant, if any, will be sited as far away from NSRs as possible; 	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		 Machines and plant (such as trucks) that may be in intermittent use will be shut down between work periods or will be throttled down to a minimum; Plant known to emit noise strongly in one direction will, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and Material stockpiles and other structures will be effectively utilised, wherever practicable, in screening noise from on-site construction activities. 			
\$5.9	-	Noise insulating sheet would be adopted for certain PME (eg drill rig, excavator for demolition of existing structures, etc). The noise insulating sheet should be deployed such that there would be no opening or gaps on the joints.	Whole Site	During √ construction	,
<i>S5.9</i>	-	Use temporary noise barriers to mitigate the noise impact arising from the construction works, particularly for low-rise NSRs. Movable noise barriers of 3 m in height with skid footing should be used and located within a few metres of stationary plant and mobile plant such that the line of sight to the NSR is blocked by the barriers. The length of the barrier should be at least five times greater than its height. The noise barrier material should have a superficial surface density of at least 7 kg m ⁻² and have no openings or gaps.	Whole Site	During √ construction	
<i>S5.9</i>	-	Use quiet PME as far as practicable to mitigate the construction noise impact.	Whole Site	During √ construction	
<i>S5.9</i>	-	Scheduling of construction activities with identified grouping of PMEs.	Whole Site	During √ construction	,
S5.11	S5	Weekly noise monitoring will be undertaken at the representative NSRs N2 Ho Fook Building and N5 Chancery House. Monthly site audits will be conducted to ensure that the recommended mitigation measures are properly implemented during the construction stage.	Whole Site	During √ construction	
Air Qu	ality				
S6.8.1	-	Dust control measures stipulated in the <i>Air Pollution Control</i> (<i>Construction Dust</i>) <i>Regulation</i> will be implemented during the construction phase to control the potential fugitive dust emissions.	Whole Site	During √ construction	

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S6.8.1	-	In particular: Temporary stockpiles of dusty materials will be either covered entirely by impervious sheets; placed in an area sheltered on the top and three sides; or sprayed with water to maintain the entire surface wet at all the time.	Whole Site	During construction	√
S6.8.1	-	Impervious sheet will be provided for skip hoist for material transport.	Whole Site	During construction	\checkmark
S6.8.1	-	Vehicle washing facilities will be provided at the designated vehicle exit points.	Whole Site	During construction	\checkmark
S6.8.1	-	Every vehicle will be washed to remove any dusty materials from its chassis and wheels immediately before leaving the worksite.	Whole Site	During construction	\checkmark
S6.8.1	-	Road sections between vehicle-wash areas and vehicular entrances will be paved.	Whole Site	During construction	\checkmark
S6.8.1	-	The load carried by the trucks will be covered entirely to ensure no dust emission from the vehicles.	Whole Site	During construction	\checkmark
S6.8.1	-	Hoarding of not less than 2.4m high from ground level will be provided along the Project Site boundary adjoining a road where the new buildings (Old Bailey Wing and Arbuthnot Wing) will be constructed.	Whole Site	During construction	\checkmark
S6.8.1	-	Stockpiles of more than 20 bags of cement, dry pulverised fuel ash and dusty construction materials will be covered entirely by impervious sheeting sheltered on top and 3-sides.	Whole Site	During construction	\checkmark
S6.8.1	-	An effective dust screen will be provided to enclose scaffolding, if required, from the ground floor level of building for construction of superstructure of the new buildings.	Whole Site	During construction	\checkmark
S6.8.1	-	Impervious dust screen or sheeting will be implemented for demolition of structures and renovation of outer surfaces of structures that abuts or fronts open area accessible to the public to no less than 1m higher than the highest level of the structure being demolished.	Whole Site	During construction	\checkmark
S6.8.1	-	The area at which demolition work takes place will be sprayed with water or dust suppression chemical immediately prior to, during and immediately after the demolition activity.	Area for Demolition Work	During construction	√

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S6.8.1	-	ULSD will be used for all construction plant on-site.	Whole Site	During construction	\checkmark
S6.8.1	-	The engine of the construction equipment or trucks during idling will be switched off.	Whole Site	During construction	\checkmark
S6.8.1	-	Site practices such as regular maintenance and checking of construction equipment deployed on-site will be conducted to avoid any black smoke emissions and to minimise gaseous emissions.	Whole Site	During construction	N/A – Not observed.
S6.10	S3.2	Monthly environmental site audits to ensure that appropriate dust control measures are properly implemented and good construction site practices are adopted throughout the construction period.	Whole Site	During construction	\checkmark
Water (Quality			1	
S7.6	-	Channels, earth bunds or sand bag barriers will be provided on site to direct stormwater to silt removal facilities. The design of silt removal facilities will make reference to the guidelines in <i>Appendix A1</i> of <i>ProPECC PN 1/94</i> . All drainage facilities and erosion and sediment control structures will be inspected on a regular basis and maintained to confirm proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit will be removed regularly.	Whole Site	During construction	\checkmark
S7.6	-	All drainage facilities and erosion and sediment control structures will be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit will be removed regularly and disposed of.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Measures will be taken to reduce the ingress of stormwater into excavation areas. If the excavation of the concrete foundation is to be carried out in wet season, they will be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations will be discharged into stormwater drains via silt removal facilities.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Open stockpiles of excavated and demolition materials will be covered with tarpaulin or similar fabric during rainstorms. Measures will be taken to prevent the washing away of residues, chemicals or debris into any drainage system.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S7.6	-	Manholes (including newly constructed ones) will always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Precautions will be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarised in Appendix A2 of <i>ProPECC PN 1/94</i> . Particular attention will be paid to the control of silty surface runoff during storm events.	Whole Site	During construction	N/A – Not observed.
S7.6	-	All temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge will be adequately designed for the controlled release of stormwater flows. All sediment traps will be regularly cleaned and maintained. The temporary diverted drainage will be reinstated to the original condition when the construction work has finished or the temporary diversion is no longer required.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Vehicle and plant servicing areas, vehicle washing bays and lubrication bays will, as far as possible, be located within roofed areas. The drainage in these covered areas will be connected to foul sewers via a petrol interceptor.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Oil leakage or spillage will be contained and cleaned up immediately. Waste oil will be collected and stored for recycling or disposal.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Waste streams classifiable as chemical wastes will be properly stored, collected and treated.	Whole Site	During construction	\checkmark
S7.6	-	All fuel tanks and chemical storage areas will be provided with locks and be sited on paved areas.	Whole Site	During construction	\checkmark
S7.6	-	The storage areas will be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled oil, fuel and chemicals from reaching the receiving waters.	Whole Site	During construction	1
S7.6	-	The Contractors will prepare guidelines and procedures for immediate clean-up actions following any spillages of oil, fuel or chemicals.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S7.6	-	Surface runoff from bunded areas will pass through oil/grease traps prior to discharge to the stormwater system	Whole Site	During construction	N/A – Not observed.
S7.6	-	The stormwater discharge from the site will be monitored as part of the routine monitoring under the WPCO licence, if applicable.	Whole Site	During construction	N/A – Not observed.
S7.6	-	The existing toilet facilities of the CPS will be available to the construction workforce. The sewage will be discharged to the public sewer.	Whole Site	During construction	\checkmark
S7.8	S5.2	Monthly site audits of the works areas will be carried out during the construction phase to monitor the environmental performance of the Project and to enable prompt actions to rectify any malpractice which may give rise to water pollution problem.	Whole Site	During construction	N
Waste I	Manageme	nt	1		
S8.5	S6.3.1 & Table 6.1	<u>General</u> The Contractor shall apply for and obtain all the necessary waste disposal permits or licences are obtained prior to the commencement of the construction works.	Whole Site	During construction	\checkmark
S8.5	-	<u>Management of Waste Disposal</u> The construction contractor will open a billing account with the EPD. Every construction waste or public fill load to be transferred to the Government waste disposal facilities such as public fill reception facilities, sorting facilities, landfills will require a valid "chit" which contains the information of the account holder to facilitate waste transaction recording and billing to the waste producer.	Whole Site	During construction	√
S8.5	S6.2	A trip-ticket system will also be established to monitor the disposal of construction waste at landfill and to control fly-tipping. The trip-ticket system will be included as one of the contractual requirements and implemented by the contractor.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S8.5	S6 & Table 6.1	A recording system for the amount of wastes generated/recycled and disposed of will be established during the construction phase.	Whole Site	During construction	\checkmark
S8.5	S6.3	<u>Reduction of Construction Waste Generation</u> C&D material will be segregated on-site into public fill and construction waste and stored in different containers or skips to facilitate reuse of the public fill and proper disposal of the construction waste. Specific areas of the work site will be designated for such segregation and storage if immediate use is not practicable.	Whole Site	During construction	\checkmark
S8.5	S6	<u>Chemical Waste</u> The contractor will register as a chemical waste producer with the EPD.	Whole Site	During construction and operation	\checkmark
S8.5	S6	 Containers used for storage of chemical waste shall: Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and Display a label in English and Chinese in accordance with instructions prescribed in <i>Schedule 2</i> of the <i>Regulations</i>. 	Whole Site	During construction and operation	\checkmark
S8.5	S6	 Storage areas for chemical waste shall: Be clearly labelled and used solely for the storage of chemical waste; Be enclosed on at least 3 sides; Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; Have adequate ventilation; Be covered to prevent rainfall entering (water collected within the bund must be tested and disposed of as chemical waste, if necessary); and Be arranged so that incompatible materials are appropriately separated. 	Whole Site	During construction and operation	√

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S8.5	S6	A licensed contractor shall be employed to collect chemical waste for delivery to a licensed treatment facility.	Chemical Waste Treatment Centre at Tsing Yi	During construction and operation	\checkmark
S8.5	S6 & Table 6.1	<u>General Refuse</u> General refuse will be stored in enclosed bins separately from construction and chemical wastes. The general refuse will be delivered to the transfer station, separately from construction and chemical wastes, on a daily basis to reduce odour, pest and litter impacts.	Whole site	During construction	\checkmark
S8.5	S6	Recycling bins will be provided at strategic locations to facilitate recovery of aluminium can and waste paper from the Site. Materials recovered will be sold for recycling.	Whole site	During construction and operation	\checkmark
S8.5	S6	<u>Staff Training</u> At the commencement of the construction works, training will be provided to workers on the concepts of site cleanliness and on appropriate waste management procedures, including waste reduction, reuse and recycling.	Whole site	Commencement of construction	\checkmark
S8.7	S6.1 & 6.3	Monthly audits of the waste management practices will be carried out during the construction phases to determine if wastes are being managed in accordance with the recommended good site practices. The audits will examine all aspects of waste management including waste generation, storage, recycling, transport and disposal.	Whole site	During construction	√

Remark:

 $\sqrt{}$ Compliance of Mitigation Measures

<> Compliance of Mitigation but need improvement

x Non-compliance of Mitigation Measures

▲ Non-compliance of Mitigation Measures but rectified by Gammon Construction Ltd

Δ Deficiency of Mitigation Measures but rectified by Gammon Construction Ltd

N/A Not Applicable in Reporting Period

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
Culture	al Heritag	ge			
S3.9.1	S3.2.6	Subject to the outcome of the archaeological investigation, if archaeological deposits are identified to be impacted by the proposed development, appropriate mitigation measures will be recommended and agreed with AMO.	In accordance with the recommendations in the Archaeological Action Plan (AAP) issued on 21 Dec 11 and approved on 30 Dec 11 by AMO	During detailed design and construction	No field work in the reporting month.
S3.9.2	S3.3.1	<u>Vibration Monitoring</u> A baseline condition survey and baseline vibration impact will be conducted by a specialist for the approval of AMO and Buildings Department prior to commencement of the construction works to define the vibration control limits and recommend a vibration monitoring proposal for the concerned historic buildings and structures in and outside CPS for AMO's prior approval before commencement of the construction works.	Historic buildings and structures in CPS, the granite walls at Old Bailey Street and the proposed Grade 3 historic building (No. 20 Hollywood Road)	During detailed design and construction	V
\$3.9.2	53.3.3	<u>Compliance of the Approved Measures and Auditing</u> Staff training by an experience building conservation expert or relevant competent person(s) in the environmental team of the project should be provided to the on-site staffs, contractors, sub-contractors and workers of the project before commencement of works to ensure their full understanding of the approved protection schedule, restoration proposal and work methodologies related to cultural heritage, and their respective responsibilities in the implementation of the environmental protection measures. Regular site audit for cultural heritage should be carried out in the construction phase by an experience building conservation expert in the environmental team ("the Heritage Checker") to investigate the site practice of the contractors and workers and their compliance of the approved work methodologies with respect of conservation works, mitigations for cultural heritage and any related works. A detailed	Whole site	Prior to and during construction	

Annex G Implementation Schedule for Environmental Protection Measures (1 October to 31 October 2013)

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		proposal of the regular audit such as methodology (e.g. performance and monitoring indicators, control tools, frequency of the audit, etc.) and the conservation professionals to be engaged should be agreed with AMO prior to work commencement. The Heritage Checker shall also attend the regular site meetings with AMO and report the compliance and effectiveness of the mitigation measures for cultural heritage.			
\$3.9.3	S3.3.4	<u>Archival Recording</u> An archival recording should be conducted to provide a detailed reference for the update of the Conservation Management Plan and inventory of historical features of the monuments, the preparation of as- built drawings showing the condition of the historic buildings and structures after the completion of the construction works. These archival records will be a reference source for future maintenance of the character defining elements, conservation of the monuments, interpretation and conservation education of the Site. The archival recording shall include but not limit to the video and photographic recording on the detailed process of the repair trials for different kinds of historical features, conservation works of character defining elements and historic fabrics of the monuments, and a written records of any new changes to the detailed design made in the construction phase illustrate with photos and drawings. A full set of the archives records (including both hard and soft copies) should be submitted to the AMO for approval after the work completion for record purpose. Any new findings related to the conservation of built heritage in the Site identified during the detailed design stage and construction phases shall be properly recorded in details for notification to the AMO and update of the Conservation Management Plan.	Whole Site	During detailed design, construction and prior to operation	N/A – Archival recording will be conducted at later stage.
S3.7.3	-	<u>General Construction Methods</u> Prior to the commencement of the modification/refurbishment works at an existing building or structure (e.g. masonry walls near the Old Bailey Wing), a site survey will be carried out by the design team, and all building dimensions and levels of the building/structure shown will be	Whole site	During construction	V

	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S3.7.1 - & 3.7.2		checked and confirmed by the contractor. Non-percussive piling methods will be adopted for the construction of the foundation for the new buildings. Protective and precaution measures to the existing buildings and structure adjacent to the work area (including the proposed Grade 3 historic building (No. 20 Hollywood road) and the granite boundary walls between the Ablutions Block of the police station (building no. 08) and the General Office of the prison area (building no. 18) which is adjacent to the new construction of the Old Bailey Wing and for an old granite walls at Old Bailey Street within 15m from the new construction) shall be provided to avoid damage to the existing features and to safeguard the structural integrity during the course of construction. Small scale handheld pneumatic tools with minimal vibration impact to the existing buildings / structures are selected so as to have a better logistic and handling at the existing buildings and structures, which usually have only narrow working areas. In cases of the local demolition of structural elements, demountable platforms will be erected to temporarily support the affected area and divert the loading from above to avoid instability and create excessive cracking and settlement of the building/structure. Implementation and update of the Conservation Management Plan (CMP). Any new findings related to the conservation of the built heritage in the site identified during the detailed design and construction, a cartographic and photographic recording on the restored historic buildings, historic features and the site shall be conducted and the following records shall be included into the CMP as appendices for updating and record purpose: • one set of measured drawings and photographic records showing the as-built condition of historic buildings and structures; and • an updated inventory list of the historic features together with the cross referenced location plans and photo records. One set of updated CMP shall be submitted to the AMO for approval before	Whole site	During detailed design, construction, post- construction and operation	√- CMP was implemented during the reporting month. There were no updates for the CMP.

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
Landsca	ipe & Visi	ıal			
S4.7.27	-	<u>In-situ Tree Protection - Cordon Zone (CZ)</u> Cordon off each tree along its drip line (below the crown) with a chain- link fencing of 2.5 m height with padlocked gate, allowing limited access to area only to authorized persons. The base of the perimeter fence will be sealed up to 30 cm height to ensure that no construction drainage water will enter. If grouting is to be conducted less than 5 m from the edge of the CZ, a waterproof membrane will be installed below the ground to a depth of 1.5 m on the outer edge of the CZ to prevent the subsurface lateral movement of contaminated construction wastewater from intruding the soil inside the CZ.	Whole site	During construction	 √ - Part of the cordon zone of Tree-5 has been used as a worker storage room. The Contractor was recommended to pay utmost attention to potential land pollution at the worker storage room at all times. Scaffolding has been set up close to Tree-5 within the cordon zone. The Contractor was reminded to perform proper measures to protect Tree-5 during the carrying out of works within the cordon zone.
S4.7.2	-	In-situ Tree Protection - Advanced & Phased Root Pruning All edges of the CZ that will be affected by excavation will undergo root pruning by a trained arborist or horticulturist, in advance of the earth work. The entire affected length of the CZ, plus 3 m additional length at both ends, shall be designated as the root pruning segment (RPS). The require trench will be opened manually in the RPS, be 1.5 m deep and 1 m wide, and closed on the same day after pruning with a good soil mix. All roots with a diameter >20 mm encountered in the course of trench opening shall be cut flushed with the inner wall of the trench. If the RPS exceeds one-quarter of the CZ circumference, the root pruning should be conducted in two stages. Each phase will tackle half of the RPS length. After the first phase, the tree will be allowed to recuperate for not less than four months before the second phase root pruning is conducted. The RPS shall be protected by sheet piles along the outer edge. The rig that installs the piles and the associated operations shall not intrude into the CZ or injure the protected tree.	Whole site	During construction	N/A – no root pruning has been conducted yet
S4.7.2	-	<u>In-situ Tree Protection - Foliage cleansing system</u> A sprinkler cleansing system will be installed either in the crown of the tree or at a suitable location on an adjacent building to provide the	Whole site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		means to wash the foliage of the accumulated dust when necessary,			
		particularly in the dry season.			
S4.7.2	S4	In-situ Tree Protection - Monthly inspection	Whole site	During construction	\checkmark
		Monthly inspection of affected trees by an experienced and appropriately trained arborist or horticulturist using Form 1 – Tree Group Inspection Form and Form 2 – Tree Risk Assessment Form developed by Development Bureau (<i>http://www.trees.gov.hk/en/doc/TRAGuideline_July2010version_combine.pdf</i>) or a form designed by a tree expert and approved by Tree Management Office. All irregularities that deviate from the recommended tree protection measures, or could impose deleterious impacts on the protected trees, must be reported to the authorized person or the tree expert within two days.			
S4.7.2	-	<u>Light Control</u> Control of night-time lighting shall be implemented to minimise impact to adjacent VSRs.	Whole site	During construction and operation	\checkmark
S4.7.2	S4	<u>Compensatory Tree Planting</u> A new planting site has been identified for compensatory tree planting in the Parade Ground. The planting is to compensate for felling of T10. The existing tree site will be enlarged to become a wide tree strip to accommodate at least six trees. The entire strip of land that accommodates T1 to T4 should be revamped to improve the soil condition for future tree growth. The new tree strip should be 4 m wide and covered by porous unit pavers to permit the entry of rain and irrigation water and air exchange between the soil and the atmosphere. The unit pavers should be supported by small columns to create a vault-like structure so as to avoid compaction of the underlying soil due to pedestrian trampling. The unit pavers will be movable to provide access to the soil underneath so that fertilizers and conditioners could be added on a	At identified compensatory tree planting location at the Parade Ground	During detailed design and construction	N/A – Compensatory Tree Planting will be conducted at later stage.

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		regular basis. The air conditioner unit currently located near the proposed planting site should also be removed. This new tree planting site should also be provided with proper irrigation.			
		Pursuant to the "Environment, Transport and Works Bureau Technical Circular (Works) No. 3/2006 Tree Preservation", the compensation ratio should preferably be 1:1 according to trunk girth. T10 has a DBH of 20 cm (<i>Table 4.3</i>), and it is proposed that six trees of heavy standard size be planted, each with a DBH of around 10 cm and root balls of not less than 0.75 m diameter and 0.75 m depth,. Since the aggregate DBH of the new trees would be 60 cm, the rate of compensation is equivalent to three times the DBH of T10, far beyond the requirements			
		The six replacement trees should be planted in the new tree strip in two staggered rows, maximising distance between each tree to avoid mutual interference in the future. It is recommended that the species selected should have a small final dimension of less than 10 m height given the proximity to built structures such as the retaining wall and buildings. Two each of the outstanding and related flowering tree species connected to local natural history are suggested::			
		 Bauhinia 'Blakeana' a native evergreen species with deep mauve flowers and an exceptionally long flowering period from late autumn to early spring. 			
		 Bauhinia purpure, a native evergreen with lighter purple flowers from late autumn to early winter. 			
		 Bauhinia variegata, an exotic deciduous species, with pale pinkish flowers in spring to early summer often when the tree has little or no leaves. 			
S4.7.2	S4	<u>Vertical Greening</u> Within the limitations of the conservation of the CPS character,	Inner Southern Wall	During detailed design and construction	N/A – No vertical greening was conducted during the reporting month.
		greening of vertical structures should be provided where possible. As such it is recommended that the inner southern wall of the Site be planted as a green wall. The plantings should be inserted in between each of the large protruding piers and an offset be made from both the			

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		top and bottom edge so that old and new are equally visible. An independent frame should be strategically positioned in order to ensure minimal disturbance to the original wall, and provide the main structural support and planting surface for the green wall. The frame on to which the new green will be planted should contain its own irrigation system so that moisture for the plants will remain mainly on the planting surface and not the exiting wall behind. The planting chosen should be appropriate to the Hong Kong climate, requiring relatively little maintenance to sustain the quality of both plants and wall.			
S4.7.2	-	<i>New Custom Paving</i> New, Patterned, High Quality, Concrete Custom Pavers should replace most of the existing paving in the open spaces.	Whole site	During detailed design and construction	N/A – No custom paving was conducted during the reporting month.
S4.7.2	S4	<u>In-situ Tree Protection - Quarterly inspection</u> Quarterly Inspection of affected and newly planted trees by an experienced and appropriately trained arborist or horticulturist using Form 1 – Tree Group Inspection Form and Form 2 – Tree Risk Assessment Form developed by Development Bureau (http://www.trees.gov.hk/en/doc/TRAGuideline_July2010version_combine.pdf) or a form designed by a tree expert and approved by Tree Management Office for a period of 12 months after construction.	Whole site	During post construction and operation	N/A – The quarterly inspection will be conducted at later stage.
Noise					
<i>S</i> 5.9	-	 The following site practices should be followed during the construction of the Project: Only well-maintained plant will be operated on-site and plant will be serviced regularly during the construction phase; Silencers or mufflers on construction equipment will be utilised and will be properly maintained during the construction phase; Mobile plant, if any, will be sited as far away from NSRs as possible; 	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
		 Machines and plant (such as trucks) that may be in intermittent use will be shut down between work periods or will be throttled down to a minimum; Plant known to emit noise strongly in one direction will, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and Material stockpiles and other structures will be effectively utilised, wherever practicable, in screening noise from on-site construction activities. 			
\$5.9	-	Noise insulating sheet would be adopted for certain PME (eg drill rig, excavator for demolition of existing structures, etc). The noise insulating sheet should be deployed such that there would be no opening or gaps on the joints.	Whole Site	During √ construction	,
<i>S5.9</i>	-	Use temporary noise barriers to mitigate the noise impact arising from the construction works, particularly for low-rise NSRs. Movable noise barriers of 3 m in height with skid footing should be used and located within a few metres of stationary plant and mobile plant such that the line of sight to the NSR is blocked by the barriers. The length of the barrier should be at least five times greater than its height. The noise barrier material should have a superficial surface density of at least 7 kg m ⁻² and have no openings or gaps.	Whole Site	During √ construction	
<i>S5.9</i>	-	Use quiet PME as far as practicable to mitigate the construction noise impact.	Whole Site	During √ construction	
<i>S5.9</i>	-	Scheduling of construction activities with identified grouping of PMEs.	Whole Site	During √ construction	,
S5.11	S5	Weekly noise monitoring will be undertaken at the representative NSRs N2 Ho Fook Building and N5 Chancery House. Monthly site audits will be conducted to ensure that the recommended mitigation measures are properly implemented during the construction stage.	Whole Site	During √ construction	
Air Qu	ality				
S6.8.1	-	Dust control measures stipulated in the <i>Air Pollution Control</i> (<i>Construction Dust</i>) <i>Regulation</i> will be implemented during the construction phase to control the potential fugitive dust emissions.	Whole Site	During √ construction	

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S6.8.1	-	In particular: Temporary stockpiles of dusty materials will be either covered entirely by impervious sheets; placed in an area sheltered on the top and three sides; or sprayed with water to maintain the entire surface wet at all the time.	Whole Site	During construction	√
S6.8.1	-	Impervious sheet will be provided for skip hoist for material transport.	Whole Site	During construction	\checkmark
S6.8.1	-	Vehicle washing facilities will be provided at the designated vehicle exit points.	Whole Site	During construction	\checkmark
S6.8.1	-	Every vehicle will be washed to remove any dusty materials from its chassis and wheels immediately before leaving the worksite.	Whole Site	During construction	\checkmark
S6.8.1	-	Road sections between vehicle-wash areas and vehicular entrances will be paved.	Whole Site	During construction	\checkmark
S6.8.1	-	The load carried by the trucks will be covered entirely to ensure no dust emission from the vehicles.	Whole Site	During construction	\checkmark
S6.8.1	-	Hoarding of not less than 2.4m high from ground level will be provided along the Project Site boundary adjoining a road where the new buildings (Old Bailey Wing and Arbuthnot Wing) will be constructed.	Whole Site	During construction	\checkmark
S6.8.1	-	Stockpiles of more than 20 bags of cement, dry pulverised fuel ash and dusty construction materials will be covered entirely by impervious sheeting sheltered on top and 3-sides.	Whole Site	During construction	\checkmark
S6.8.1	-	An effective dust screen will be provided to enclose scaffolding, if required, from the ground floor level of building for construction of superstructure of the new buildings.	Whole Site	During construction	\checkmark
S6.8.1	-	Impervious dust screen or sheeting will be implemented for demolition of structures and renovation of outer surfaces of structures that abuts or fronts open area accessible to the public to no less than 1m higher than the highest level of the structure being demolished.	Whole Site	During construction	\checkmark
S6.8.1	-	The area at which demolition work takes place will be sprayed with water or dust suppression chemical immediately prior to, during and immediately after the demolition activity.	Area for Demolition Work	During construction	√

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S6.8.1	-	ULSD will be used for all construction plant on-site.	Whole Site	During construction	\checkmark
S6.8.1	-	The engine of the construction equipment or trucks during idling will be switched off.	Whole Site	During construction	\checkmark
S6.8.1	-	Site practices such as regular maintenance and checking of construction equipment deployed on-site will be conducted to avoid any black smoke emissions and to minimise gaseous emissions.	Whole Site	During construction	N/A – Not observed.
S6.10	S3.2	Monthly environmental site audits to ensure that appropriate dust control measures are properly implemented and good construction site practices are adopted throughout the construction period.	Whole Site	During construction	\checkmark
Water (Quality			1	
S7.6	-	Channels, earth bunds or sand bag barriers will be provided on site to direct stormwater to silt removal facilities. The design of silt removal facilities will make reference to the guidelines in <i>Appendix A1</i> of <i>ProPECC PN 1/94</i> . All drainage facilities and erosion and sediment control structures will be inspected on a regular basis and maintained to confirm proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit will be removed regularly.	Whole Site	During construction	\checkmark
S7.6	-	All drainage facilities and erosion and sediment control structures will be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit will be removed regularly and disposed of.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Measures will be taken to reduce the ingress of stormwater into excavation areas. If the excavation of the concrete foundation is to be carried out in wet season, they will be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations will be discharged into stormwater drains via silt removal facilities.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Open stockpiles of excavated and demolition materials will be covered with tarpaulin or similar fabric during rainstorms. Measures will be taken to prevent the washing away of residues, chemicals or debris into any drainage system.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S7.6	-	Manholes (including newly constructed ones) will always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Precautions will be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarised in Appendix A2 of <i>ProPECC PN 1/94</i> . Particular attention will be paid to the control of silty surface runoff during storm events.	Whole Site	During construction	N/A – Not observed.
S7.6	-	All temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge will be adequately designed for the controlled release of stormwater flows. All sediment traps will be regularly cleaned and maintained. The temporary diverted drainage will be reinstated to the original condition when the construction work has finished or the temporary diversion is no longer required.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Vehicle and plant servicing areas, vehicle washing bays and lubrication bays will, as far as possible, be located within roofed areas. The drainage in these covered areas will be connected to foul sewers via a petrol interceptor.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Oil leakage or spillage will be contained and cleaned up immediately. Waste oil will be collected and stored for recycling or disposal.	Whole Site	During construction	N/A – Not observed.
S7.6	-	Waste streams classifiable as chemical wastes will be properly stored, collected and treated.	Whole Site	During construction	\checkmark
S7.6	-	All fuel tanks and chemical storage areas will be provided with locks and be sited on paved areas.	Whole Site	During construction	\checkmark
S7.6	-	The storage areas will be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled oil, fuel and chemicals from reaching the receiving waters.	Whole Site	During construction	\checkmark
S7.6	-	The Contractors will prepare guidelines and procedures for immediate clean-up actions following any spillages of oil, fuel or chemicals.	Whole Site	During construction	√

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S7.6	-	Surface runoff from bunded areas will pass through oil/grease traps prior to discharge to the stormwater system	Whole Site	During construction	N/A – Not observed.
S7.6	-	The stormwater discharge from the site will be monitored as part of the routine monitoring under the WPCO licence, if applicable.	Whole Site	During construction	N/A – Not observed.
S7.6	-	The existing toilet facilities of the CPS will be available to the construction workforce. The sewage will be discharged to the public sewer.	Whole Site	During construction	\checkmark
S7.8	S5.2	Monthly site audits of the works areas will be carried out during the construction phase to monitor the environmental performance of the Project and to enable prompt actions to rectify any malpractice which may give rise to water pollution problem.	Whole Site	During construction	N
Waste I	Manageme	nt	1		
S8.5	S6.3.1 & Table 6.1	<u>General</u> The Contractor shall apply for and obtain all the necessary waste disposal permits or licences are obtained prior to the commencement of the construction works.	Whole Site	During construction	\checkmark
S8.5	-	<u>Management of Waste Disposal</u> The construction contractor will open a billing account with the EPD. Every construction waste or public fill load to be transferred to the Government waste disposal facilities such as public fill reception facilities, sorting facilities, landfills will require a valid "chit" which contains the information of the account holder to facilitate waste transaction recording and billing to the waste producer.	Whole Site	During construction	√
S8.5	S6.2	A trip-ticket system will also be established to monitor the disposal of construction waste at landfill and to control fly-tipping. The trip-ticket system will be included as one of the contractual requirements and implemented by the contractor.	Whole Site	During construction	\checkmark

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S8.5	S6 & Table 6.1	A recording system for the amount of wastes generated/recycled and disposed of will be established during the construction phase.	Whole Site	During construction	\checkmark
S8.5	S6.3	<u>Reduction of Construction Waste Generation</u> C&D material will be segregated on-site into public fill and construction waste and stored in different containers or skips to facilitate reuse of the public fill and proper disposal of the construction waste. Specific areas of the work site will be designated for such segregation and storage if immediate use is not practicable.	Whole Site	During construction	\checkmark
S8.5	S6	<u>Chemical Waste</u> The contractor will register as a chemical waste producer with the EPD.	Whole Site	During construction and operation	\checkmark
S8.5	S6	 Containers used for storage of chemical waste shall: Be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; Have a capacity of less than 450 L unless the specifications have been approved by the EPD; and Display a label in English and Chinese in accordance with instructions prescribed in <i>Schedule 2</i> of the <i>Regulations</i>. 	Whole Site	During construction and operation	\checkmark
S8.5	S6	 Storage areas for chemical waste shall: Be clearly labelled and used solely for the storage of chemical waste; Be enclosed on at least 3 sides; Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; Have adequate ventilation; Be covered to prevent rainfall entering (water collected within the bund must be tested and disposed of as chemical waste, if necessary); and Be arranged so that incompatible materials are appropriately separated. 	Whole Site	During construction and operation	V

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Location	When to Implement the Measure	Status
S8.5	S6	A licensed contractor shall be employed to collect chemical waste for delivery to a licensed treatment facility.	Chemical Waste Treatment Centre at Tsing Yi	During construction and operation	\checkmark
S8.5	S6 & Table 6.1	<u>General Refuse</u> General refuse will be stored in enclosed bins separately from construction and chemical wastes. The general refuse will be delivered to the transfer station, separately from construction and chemical wastes, on a daily basis to reduce odour, pest and litter impacts.	Whole site	During construction	\checkmark
S8.5	S6	Recycling bins will be provided at strategic locations to facilitate recovery of aluminium can and waste paper from the Site. Materials recovered will be sold for recycling.	Whole site	During construction and operation	\checkmark
S8.5	S6	<u>Staff Training</u> At the commencement of the construction works, training will be provided to workers on the concepts of site cleanliness and on appropriate waste management procedures, including waste reduction, reuse and recycling.	Whole site	Commencement of construction	\checkmark
S8.7	S6.1 & 6.3	Monthly audits of the waste management practices will be carried out during the construction phases to determine if wastes are being managed in accordance with the recommended good site practices. The audits will examine all aspects of waste management including waste generation, storage, recycling, transport and disposal.	Whole site	During construction	√

Remark:

 $\sqrt{}$ Compliance of Mitigation Measures

<> Compliance of Mitigation but need improvement

x Non-compliance of Mitigation Measures

▲ Non-compliance of Mitigation Measures but rectified by Gammon Construction Ltd

Δ Deficiency of Mitigation Measures but rectified by Gammon Construction Ltd

N/A Not Applicable in Reporting Period

Annex H

Noise Monitoring Results

Annex H Noise Monitoring Results

Daytime Noise Monitoring Results

NM6 Chancery Mansion

Date	Start Time	End Time	Weather	Noise	level (dB(A)), 30 min	Major Construction Noise Source(s) Observed	Other Noise Source(s)	Remarks	Wind Speed	Noise Meter	Calibrator
				Leq	L10	L90	Source(s) Observed	Observed		(m/s)	Model / ID	Model / ID
06-Aug-13	13:38	14:08	Sunny	67.3	68.5	66.2	Crawler crane (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
12-Aug-13	13:38	14:08	Sunny	67.7	69.8	64.6	Crawler crane (within the project site)	Traffic Noise	-	0.2	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
17-Aug-13	9:43	10:13	Fine	68.4	69.7	65.9	Crawler crane (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
23-Aug-13	9:43	10:13	Cloudy	67.9	69.5	66.0	Crawler crane (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
29-Aug-13	13:38	14:08	Sunny	68.6	69.7	67.6	Crawler crane, compressor (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
			Min.	67.3								
			Max.	68.6								

NM2 Ho Fook Building

Date	Start Time	End Time	Weather	Noise	level (dB(A)), 30 min	Major Construction Noise Source(s) Observed	Source(s)	Remarks	Wind Speed	Noise Meter	Calibrator
Date	Start Time	Ling time	weather	Leq	L10	L90	Source(s) Observed	Observed	nemarka	(m/s)	Model / ID	Model / ID
06-Aug-13	14:16	14:46	Sunny	68.1	69.5	66.7	Crawler crane, excavation (within the project site)	Traffic noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
12-Aug-13	14:58	15:28	Sunny	70.5	72.3	68.1	Crawler crane, excavation (within the project site)	Traffic Noise	-	0.2	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
17-Aug-13	10:20	10:50	Fine	68.9	70.3	65.8	Crawler crane, excavation (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
23-Aug-13	10:21	10:51	Cloudy	69.5	70.9	66.2	Crawler crane, excavation (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
29-Aug-13	14:16	14:46	Sunny	73.6	75.6	71.5	Crawler crane, excavation, concreting (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
			Min.	68.1								
			Max.	73.6								

Annex H Noise Monitoring Results

Daytime Noise Monitoring Results

NM6 Chancery Mansion

Date	Start Time	End Time	Weather	Noise	level (dB(A)), 30 min	Major Construction Noise Source(s)	Other Noise Source(s)	Remarks	Wind Speed (m/s)	Noise Meter Model / ID	Calibrator Model / ID
				Leq	L10	L90	Observed	Observed		(111/5)	wodel / ID	Wodel / ID
04-Sep-13	13:40	14:10	Cloudy	67.9	69.4	65.5	Crawler crane (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
10-Sep-13	15:00	15:30	Sunny	70.7	71.4	69.2	Crawler crane, compressor (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
16-Sep-13	13:37	14:07	Sunny	68.7	70.1	67.8	Crawler crane, compressor (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
21-Sep-13	10:21	10:51	Sunny	69.0	70.2	67.9	Crawler crane, compressor (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
27-Sep-13	13:38	14:08	Sunny	69.2	70.4	67.5	Crawler crane, compressor (within the project site)	Traffic Noise	-	0.6	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
			Min.	67.9								•
			Max.	70.7								

NM2 Ho Fook Building

Date	Start Time	End Time	Weather	Noise	level (dB(A)), 30 min	Major Construction Noise Source(s)	Other Noise Source(s)	Remarks	Wind Speed	Noise Meter Model / ID	Calibrator Model / ID
				Leq	L10	L90	Observed	Observed		(m/s)	Model / ID	wodel / ID
04-Sep-13	13:00	13:30	Cloudy	66.5	68.0	64.2	Crawler crane (within the project site)	Traffic noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
10-Sep-13	14:16	14:46	Sunny	68.1	70.2	66.1	Crawler crane (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
16-Sep-13	14:15	14:45	Sunny	69.3	71.5	66.2	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
21-Sep-13	9:43	10:13	Sunny	68.6	70.2	65.8	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
27-Sep-13	14:16	14:46	Sunny	68.2	69.5	65.6	Crawler crane (within the project site)	Traffic Noise	-	0.6	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
			Min.	66.5								•
			Max.	69.3								

Annex H Noise Monitoring Results

Daytime Noise Monitoring Results


NM6 Chancery Mansion

Date	Start Time	End Time	Weather	Noise	level (dB(A)), 30 min	Major Construction Noise Source(s)	Other Noise Source(s) Observed	Remarks	Wind Speed (m/s)	Noise Meter Model / ID	Calibrator Model / ID
				Leq	L10	L90	Observed	Observed		(
03-Oct-13	10:20	10:50	Sunny	67.7	69.2	63.9	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
09-Oct-13	15:03	15:33	Sunny	69.7	72.7	66.1	Crawler crane (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
15-Oct-13	9:40	10:10	Sunny	67.3	68.8	64.8	Crawler crane (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
21-Oct-13	14:55	15:25	Sunny	68.3	69.6	67.0	Crawler crane (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
26-Oct-13	9:40	10:10	Sunny	67.5	68.9	64.4	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.8	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
			Min.	67.3								
			Max.	69.7								

NM2 Ho Fook Building

Date	Start Time	End Time	Weather	Noise	level (dB(A)), 30 min	Major Construction Noise Source(s)	Other Noise Source(s)	Remarks	Wind Speed	Noise Meter Model / ID	Calibrator Model / ID
				Leq	L10	L90	Observed	Observed		(m/s)	wodel / ID	Model / ID
03-Oct-13	9:42	10:12	Sunny	70.2	72.4	66.5	Crawler crane, interior fitting, welding (within the project site)	Traffic noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
09-Oct-13	13:05	13:35	Sunny	67.6	69.9	65.4	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.3	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
15-Oct-13	10:17	10:47	Sunny	68.3	69.9	66.0	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
21-Oct-13	14:15	14:45	Sunny	69.8	71.3	66.6	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.5	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
26-Oct-13	10:17	10:47	Sunny	68.3	69.8	66.0	Crawler crane, interior fitting (within the project site)	Traffic Noise	-	0.7	RION- NL31 (S/N 00410224)	RION - NC73 (S/N 10786708)
			Min.	67.6			· ·					
			Max.	70.2								



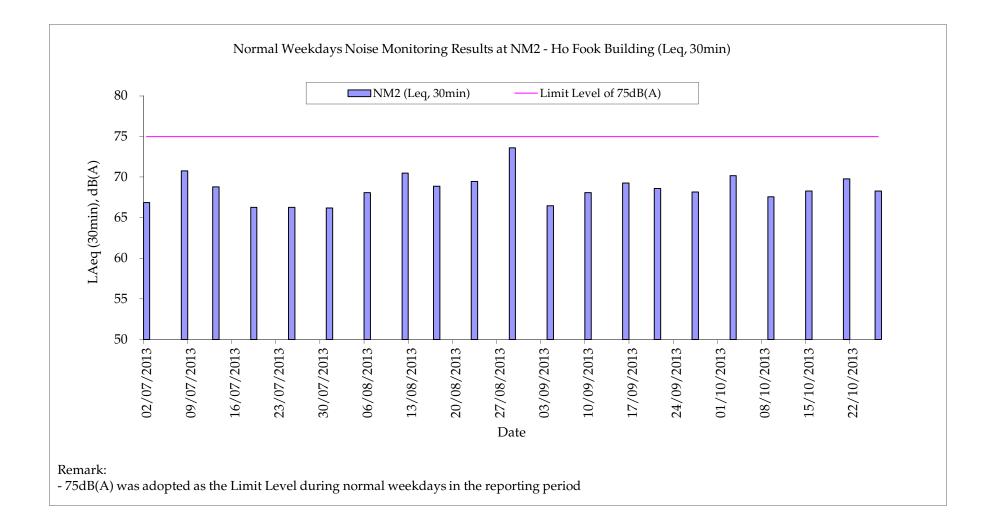

Annex I

Construction Programme of the Project

Activity ID	Activity Description	Duration in Days	I A S O N D . I F M A M . I . I A S O N D . I F M A M . I . I A S O N D . I F M A M . I . I A S O N D . I F M A M . I . I A S O N D . I F M A M . I . I A	
GENERA		III Days		Marina marina Marina marina
S110	PRECONSTRUCTION WORKS	592		
	BUILDINGS	002		
160010	BLOCK 16 WORKSHOP & LAUNDRY (DEMOLITION WORKS)	198		
180010	BLOCK 18/14 ANNEX/BLDG F/G/H/ (DEMOLITION WORKS)	149	BLOCK:18/14/ANNEX/BLOG/F/G/H/ (DEMOLITION WORKS)	
080010	BLOCK 08 ABLUTIONS BLOCK	731		
170005	BLOCK 17 F HALL	593		
010005	BLOCK 01 POLICE HEADQUARTERS BLOCK	626		
140005	BLOCK 14 D HALL	645		
120010	BLOCK 12 B HALL	341		
110010	BLOCK 11 A HALL	311	-	
100010	BLOCK 10 SUPERINTENDENT'S HOUSE	517		
130010	BLOCK 13 C HALL	517	Т : : : : : : : : : : : : : : : : : : :	
060005	BLOCK 06 MARRIED SERGEANTS' QUARTERS	223	BLOCK 06 MARRIED SERGEANTS QUARTERS	
070005	BLOCK 07 SINGLE INSPECTORS' QUARTERS	225		
030005	BLOCK 03 BARRACK BLOCK	440		
020005	BLOCK 02 ARMOURY	425		
090005	BLOCK 09 CENTRAL MAGISTRACY	425		
150010	BLOCK 15 E HALL	304		
040005	BLOCK 04 MARRIED INSPECTORS' QUARTERS	349	BLOCK 04 MARRIED INSPECTORS QUARTERS	
190005	BLOCK 19 BAUHINIA HOUSE	277		
050002	BLOCK 05 (DEMOLITION WORKS)	119		
OTHER V	VORKS			
253110	REVETMENT WALL / U/G UTILITIES / ROAD WORKS	679		DWORK
NEW BUI	LDINGS	-		
S200	OBW OLD BAILEY WING	1,097		
S300	AW ARBUTHNOT WING	1,056		
BASEME	NT PLANTROOM AND SERVICES TRENCH			
	BASEMENT PLANTROOM / SERVICES TRENCH	588	BASEMENT, PLANTROOM!/ SERVICES TRENCH	
NEW FOO	OTBRIDGE			
2300125	PROPOSED FOOTBRIDGE	699		
	Т76М		Sheet 1 of 1 GCL / P / J3416 /SUM/CP01 Date Revision Checkert	



CENTRAL POLICE STATION CONSERVATION AND REVITALIZATION (MANAGEMENT CONTRACT) CONSTRUCTION PROGRAMME SUMMARY PROGRAMME

GCL / P / J3416 /SUM/CP01										
Date	Revision	Checked	Approved							
13NOV12	for EPD									
04MAR13	revised									

Annex J

Waste Flow Table

Month / Year					Qu	ıantity					
	C&D Materials (inert) (tonnes) ^(a)	Number of Trucks for C&D Materials Disposal (inert)	Volume of C&D Materials (inert) (m ³) ^(c)	C&D Materials (non-inert) (tonnes) ^(b)	Number of Trucks for C&D Materials Disposal (non-inert)	Volume of C&D Materials (non- inert) (m ³) ^(c)		Chemical Waste (Liquid/L)	Recycled materials	Plastics (kg)	Metals (kg)
October 2011 –									1 0	. 0	. 0.
November 2011 –											
	0	0	0	33.5	12	58.50	0	0	38	6	36423
December-11	0	0	0	18.25	6	29.25	0	0	112	0	24000
anuary-12	354.14	40	195.00	16.88	5	24.38	2400	0	0	0	3820
February-12	252.35	15	73.13	17.13	5	24.38	1400	0	223	0	8910
March-12	666.43	62	302.25	28.56	9	43.88	3200	0	0	0	48490
April-12	688.68	72	351.00	17.54	5	24.38	0	0	0	0	124030
May-12	492.33	61	297.38	36.33	13	63.38	0	0	266	0	0
une-12	383.11	45	219.38	27.41	8	39.00	40	45	0	0	1100
uly-12	217.98	25	121.88	23.22	8	39.00	0	0	302	0	1750
August-12	341.87	42	204.75	48.87	16	78.00	0	0	0	0	2310
September-12	227.7	29	141.38	37.99	12	58.50	0	0	383	0	1410
October-12	290.58	44	214.50	30.34	8	39.00	0	0	86	0	3150
November-12	843.86	100	487.50	47.44	15	73.13	0	0	0	0	5650
December-12	207.5	27	131.63	88.66	28	136.50	0	0	0	0	27230
anuary-13	273.64	34	165.75	276.17	74	360.75	0	0	172	0	8120
ebruary-13	945.97	131	638.63	177.54	46	224.25	0	0	0	0	1080
Aarch-13	1236.96	151	736.13	230.55	60	292.50	0	0	164	0	11300
April-13	1406.79	187	911.63	232.27	63	307.13	135	12	225	0	21220
May-13	2679.91	317	1545.38	176.68	44	214.50	0	0	62	0	17286
une-13	3062.38	356	1735.50	212.63	56	273.00	0	0	0	0	7150
uly-13	3814.86	465	2266.88	114.36	43	209.63	0	0	168	0	14843
August-13	2831.78	353	1720.88	89.23	25	121.88	0	0	0	0	7190
September-13	979.49	141	687.38	103.73	29	141.38	40	0	0	0	4030
October-13	2170.54	270	1316.25	157.48	41	199.88	135	0	0	0	3120
Tota		2967	14464.125	2242.76	631	3076.13	7350	57	2201	6	383612

Annex J – Waste Flow Table

Notes:

(a) Inert C&D materials (public fill) include bricks, concrete, building debris, rubble and excavated soil.

(b) Non-inert C&D materials include steel, paper / cardboard packaging waste, plastics and other wastes such as general refuse. Steel materials generated from the Project are grouped into construction wastes as the materials were not disposed of with other inert C&D materials and were recycled. The non-inert C&D materials other than steel, plastics and paper / cardboard packaging were disposed of at SENT Landfill.

(c) If necessary, use the conversion factor: 3/4 load of dumping truck being equivalent to 6.5 m^3 by volume.

Annex K

Environmental Complaint, Environmental Summons and Prosecution Log

Reporting Month	Number of Complaints in Reporting Month	Number of Summons/Prosecutions in Reporting Month
November 2011	0	0
December 2011	0	0
January 2012	0	0
February 2012	0	0
March 2012	4	0
April 2012	0	0
May 2012	0	0
June 2012	2	0
July 2012	1	0
August 2012	0	0
September 2012	0	0
October 2012	0	0
November 2012	2	0
December 2012	0	0
January 2013	0	0
February 2013	1	0
March 2013	1	0
April 2013	0	0
May 2013	0	0
June 2013	0	0
July 2013	0	0
August 2013	0	0
September 2013	0	0
October 2013	0	0
Overall Total	11	0

Annex K Cumulative Complaint and Summons/Prosecutions Log

ENVIRONMENTAL RESOURCES MANAGEMENT

Annex L

Records of Vibration Monitoring for Trial Piling and Piling Works



							1	Trigger Levels			
GG					Monitoring Check Pts.		Alert level				
	amm	on			Vibration Monitoring		2mm/s	2.5mm/s	3mm/s		
						largest span of	211111/3	2.511111/3	5111185		
						uctural level	5.0mm/s	6.0mm/s	7.5mm/s		
				Vibration	Record						
Project Title: Centr	ral Police Sta	ation Conserv	ation & Revi	italization	Project No:	WP107	1-Aug-2013	to	14-Aug-2013		
		ound Baseme			-						
POINT	VM1-1*	#VM 1-2*	VM2 -1	VM3-1**	#VM3-2**						
DATE	mm/s	mm/s	mm/s	mm/s	mm/s						
19-Jun-2012 (Initial)											
01-Aug-13	0.436	0.326	0.091	0.507	0.329						
02-Aug-13	0.278	0.225	0.103	0.476	0.286						
03-Aug-13	0.117	0.151	0.094	0.106	0.131						
04-Aug-13					Sunday						
05-Aug-13	0.220	0.310	0.105	0.278	0.196						
06-Aug-13	0.109	0.250	0.301	0.313	0.190						
07-Aug-13	0.290	0.220	0.169	0.189	0.275						
08-Aug-13	0.145	0.167	0.089	0.264	0.204						
09-Aug-13	0.351	0.137	0.126	0.275	0.168						
10-Aug-13	0.201	0.182	0.088	0.337	0.194						
11-Aug-13					Sunday		,				
12-Aug-13	0.126	0.106	0.114	0.236	0.161						
13-Aug-13	0.234	0.162	0.209	0.341	0.159						
14-Aug-13	0.219	0.183	0.096	0.195	0.137						
Remarks: # Vbration at	largest span of	highest structur	al level								

* This point overlaps with Works Package 202 Block 1.

** This point overlaps with Works Package 202 Block 3.

Prepared by : Wong Wing Yee

Endorsed by: Yee Hop

							I	Triacan Laval	
GG					Monitoring Check Pts.		Alert level	Trigger Levels Alarm level	
	amme	on			Vibration Monitoring		2mm/s	2.5mm/s	Action level 3mm/s
						largest span of	211111/8	2.911111/8	51111/8
						actural level	5.0mm/s	6.0mm/s	7.5mm/s
				Vibration	Record				
Project Title: Centr	ral Police Sta	tion Conserv	ation & Revi	talization	Project No:	WP107	15-Aug-2013	to	28-Aug-2013
(WP10	7 Parade Gr	ound Baseme	nt)	-		-			_
POINT	VM1-1*	#VM 1-2*	VM2 -1	VM3-1**	#VM3-2**				
DATE	mm/s	mm/s	mm/s	mm/s	mm/s				
19-Jun-2012 (Initial)									
15-Aug-13	0.223	0.194	0.157	0.291	0.116				
16-Aug-13	0.265	0.311	0.184	0.419	0.166				
17-Aug-13	0.168	0.136	0.113	0.194	0.274				
18-Aug-13					Sunday				
19-Aug-13	0.124	0.116	0.143	0.116	0.192				
20-Aug-13	0.554	0.106	0.098	0.203	0.183				
21-Aug-13	0.146	0.137	0.194	0.323	0.244				
22-Aug-13	0.158	0.109	0.164	0.206	0.168				
23-Aug-13	0.152	0.118	0.117	0.185	0.152				
24-Aug-13	0.213	0.185	0.121	0.279	0.103				
25-Aug-13					Sunday		. <u></u>		
26-Aug-13	0.150	0.112	0.184	0.192	0.241				
27-Aug-13	0.156	0.256	0.099	0.181	0.125				
28-Aug-13	0.194	0.102	0.142	0.311	0.183				
Remarks: # Vbration at	largest span of	highest structur	al level						

* This point overlaps with Works Package 202 Block 1.

** This point overlaps with Works Package 202 Block 3.

Prepared by : Wong Wing Yee

Endorsed by: Yee Hop

								Trigger Levels	
	Gamm	00			Monitoring Check Pts.		Alert level	Alarm level	Action level
	Jannin				Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
						largest span of uctural level	5.0mm/s	6.0 mm/s	7.5mm/s
				Vibration	Record				
Project Title: Ce	ntral Police Sta	ation Conserv	ation & Rev	italization	Project No:	WP107	29-Aug-2013	to	31-Aug-201
(WP	107 Parade Gr	ound Baseme	nt)	-	-				
POINT	VM1-1*	#VM1-2*	VM2 -1	VM3-1**	#VM3-2**				
DATE	mm/s	mm/s	mm/s	mm/s	mm/s				
19-Jun-2012 (Initial	l)								
29-Aug-13	0.153	0.143	0.091	0.150	0.278				
30-Aug-13	0.143	0.677	0.164	0.203	0.137				
31-Aug-13	0.129	0.161	0.114	0.186	0.143				
						1	<u>т</u> т		
							┨────┤		<u> </u>
Remarks: # Vbration									1

* This point overlaps with Works Package 202 Block 1.

** This point overlaps with Works Package 202 Block 3.

Prepared by : Wong Wing Yee

Endorsed by: Yee Hop

•
Gammon

Monitoring Choole Dto	Trigger Levels					
Monitoring Check Pts.	Alert level	Alarm level	Action level			
Vibration Monitoring	2mm/s	2.5mm/s	3mm/s			
# Vibration at largest span of highest Structural level	5.0 mm/s	6.0 mm/s	7.5mm/s			


POINT	VM1-1*	#VM1-2*	VM2-1	VM3-1**	#VM3-2**
DATE	mm/s	mm/s	mm/s	mm/s	mm/s
02-Sep-13	0.166	0.170	0.086	0.242	0.124
03-Sep-13	0.580	0.303	0.692	0.272	0.098
04-Sep-13	0.138	0.167	0.211	0.186	0.149
05-Sep-13	0.159	0.104	0.438	0.212	0.256
06-Sep-13	0.160	0.102	0.087	0.197	0.135
07-Sep-13	0.095	0.169	0.462	0.166	0.150
08-Sep-13			SUNDAY		
09-Sep-13	0.139	0.178	0.527	0.422	0.136
10-Sep-13	0.548	0.137	0.098	0.346	0.157
11-Sep-13	0.207	0.087	0.086	0.287	0.145
12-Sep-13	0.335	0.841	0.144	0.270	0.365
13-Sep-13	0.090	0.121	0.083	0.194	0.160
14-Sep-13	0.323	0.446	0.091	0.230	0.122
15-Sep-13			SUNDAY		
16-Sep-13	0.137	0.112	0.105	0.258	0.151
17-Sep-13	0.120	1.190	0.139	0.805	0.178
18-Sep-13	0.382	0.102	0.111	0.175	0.091
19-Sep-13	0.131	0.108	0.083	0.469	0.108
20-Sep-13			HOLIDAY		
21-Sep-13	0.422	0.583	0.131	0.534	0.350
22-Sep-13			SUNDAY		
23-Sep-13	0.478	0.639	0.209	0.194	0.095
24-Sep-13	0.147	0.164	0.163	0.531	0.116
25-Sep-13	0.165	0.143	0.086	0.116	0.128
26-Sep-13	0.128	0.870	0.094	1.020	0.166
27-Sep-13	0.172	0.189	0.103	0.462	0.318
28-Sep-13	0.384	0.230	0.158	0.270	0.367
29-Sep-13			SUNDAY		
30-Sep-13	0.302	0.158	0.094	0.175	0.136

Remarks: # Vibration at largest span of highest structural level



Gammon Vibration Record of WP 107

POINT	VM1-1	VM1-2	VM2 -1	VM 3-1	VM 3-2				
Date	mm/s	mm/s	mm/s	mm/s	mm/s				
01-10-13		HOLIDAY							
02-10-13	0.207	0.362	0.093	0.172	0.196				
03-10-13	0.178	0.156	0.267	0.091	0.106				
04-10-13	0.122	0.212	0.133	0.131	0.086				
05-10-13	0.208	0.151	0.181	0.230	0.367				
06-10-13			SUNDAY						
07-10-13	0.143	0.200	0.128	0.157	0.150				
08-10-13	0.108	0.184	0.122	0.207	0.178				
09-10-13	0.160	0.239	0.132	0.484	0.145				
10-10-13	0.561	0.257	0.349	0.285	0.103				
11-10-13	0.093	0.194	0.132	0.103	0.228				
12-10-13	0.158	0.177	0.171	0.217	0.339				
13-10-13			SUNDAY						
14-10-13			HOLIDAY						
15-10-13	0.299	0.223	0.095	0.166	0.086				
16-10-13	0.102	0.223	0.117	0.255	0.139				
17-10-13	0.194	0.577	0.816	0.608	0.119				
18-10-13	0.160	0.153	0.543	0.097	0.081				
19-10-13	0.398	0.201	0.256	0.238	0.146				
20-10-13			SUNDAY						
21-10-13	0.445	0.280	0.288	0.936	0.164				
22-10-13	0.237	0.221	0.239	0.137	0.377				
23-10-13	0.272	0.216	0.087	0.106	0.377				
24-10-13	0.121	0.166	0.091	0.108	0.279				
25-10-13	0.122	0.256	0.270	0.093	0.177				
26-10-13	0.234	0.564	0.240	0.339	0.188				
27-10-13			SUNDAY						
28-10-13	0.580	0.122	0.481	0.243	0.319				
29-10-13	0.819	0.357	0.671	0.137	0.222				
30-10-13	0.207	0.415	0.774	0.358	0.127				
31-10-13	0.403	0.446	0.276	0.192	0.230				

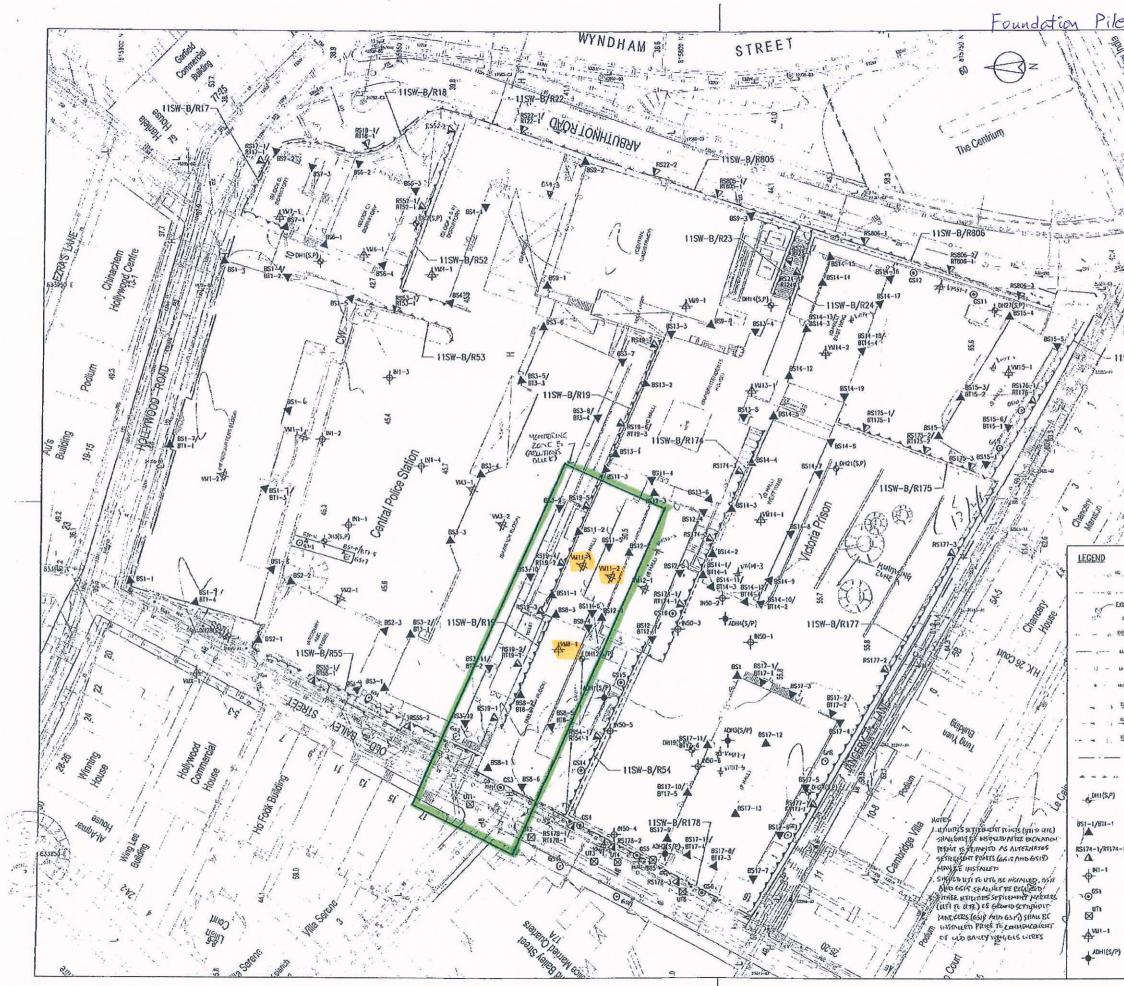

Block & at Pile Works SO Rel IN SHEDKAS - ED SJEARSSION 12/11 29985 Shiu King Court 000 Plan Approved 9500 tis NG Kin-shing Chill Structural Engineer for BUILDING AUTHORITY 20 FEB 2012 2.54 Key Plan 常引四 - 115W-B/R176 BD SUBMISSION Drawing Status 製图狀況 - This many and co mains been at \$c o of sky of conducts 本文社及代史書的語言が知られて知知られたら。 EWAY KIN X 4월2021 IV 10 ISB 6 8 II 12 3 6 97 11 13 16 Ho gan of the drawing and the design conserved here a Ery to expression of whom the prior action conserved relevant consultants 조합 [[[10] (FD]) 218 월(일도, 平강산성관군) 49 5 % 위험 ([11] Ou mi lake seaso as only in Which TEELFERRI. Cod and only alderertoors on Site EXISTING FRESH WATER WAIN Rest Res drawny a convertion with the specific and a mixer when it drawnys RES 2300 Rt 21 R 21 R 21 E E E - IF 21. EXISTING SALT WATER WAN - EXISTING STREET LIGHTING NO. 33488-A1 normany builters Breachtricel, edigerents DUSTING STREET LIGHTING CABL len III RUAZORATIRAN Ibe Jacker Clab CPS Lielted EXISTING GAS MAIN DUSTING HY ELECTRICITY CABLE EXISTING LY ELECTROITY CABLE HERZOG GDE MEURON EDISTING TELECOMMUNICATION DUCT trefthy anima HUTCHISON GLOBAL COMMUNICATION LAMITED) EXISTING STORMWATUR DRAIN Vanders Arrindert \$ 25 ROCCO 许尔 14 EXISTING FOUR SEWER PROPOSED FOLK SEWER E & M Engine Suvaural Engineer / RSE R. JRP STE DOUNDARD ARUP DUSTING RETAINING WALL Project INEL CENTRAL POLICE STATION CONSERVATION AND REVITALISATION PROJECT FXCSTING ORIHINGEF WITH STANDFIPE/PEZOWETER Drawing Takes MONITORING LAYOUT PLAN PROPOSED BURLOWC SETTLEMENT POINTS/TR_TWETER PROPOSED RETAINING WALL SETTLEMENT PORTS/TILTMETER Scale LER Draven S.E. PROPOSED INCLINOUETER TO BE FAINT IN TECTED FILE WALL OL IPIPE FILE WALL KCLd 1:3000A1 00-0AP209674-G-001 PROPOSED GROUND SETTLEMENT PORITS PROPOSED LITELY MONTORING PODITS PROPOSED VERATION MONITORING POINTS PROPOSED ADDITIONAL DEALHOLE Cost fire : 00-04/209571-G-001.049

14/14/	•						(Block 8 Foundation)				
VV VV	恆調	战建築 工	程有限	公司		Monitoring	g Check Pts.	Trigger Levels			
Win Win	Way (Constructi	on Compar	ny Ltd.				Alert level	Alarm level	Action level	
	10.00						Monitoring	2mm/s	2.5mm/s	3mm/s	
							largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s	
Vibration Record											
Project Title: C	entral Po	lice Station C	Conservation &	Revitalization		Project No: W	/P201	28-Jul-2013	to	10-Aug-2013	
POINT		VM8-1	VM11-1#	VM11-2							
DATE	PD/(m)	mm/s	mm/s	mm/s							
23-Apr-2012 (Ir	nitial)	0.212	0.087	0.116							
28-Jul-2013						Sunday					
29-Jul-2013		0.33	0.57	0.47							
30-Jul-2013		0.76	0.21	0.17							
31-Jul-2013		0.75	0.75	0.20							
1-Aug-2013		0.22	0.58	0.23							
2-Aug-2013		0.19	0.24	0.26							
3-Aug-2013		1.00	0.51	0.16							
4-Aug-2013						Sunday					
5-Aug-2013		0.38	0.34	0.85							
6-Aug-2013		0.82	0.50	1.43							
7-Aug-2013		0.16	0.15	0.57							
8-Aug-2013		0.19	0.40	0.39							
9-Aug-2013		0.34	0.39	0.14							
10-Aug-2013		0.35	0.35	0.32							

							(Block 8 F	oundation)	
WW 恆	计7月4分子 丁子	阳古阳八			Monitoring Ch	eck Pts		Trigger Level	S
	滅建榮上位	至月1次2	ノロー		Wolldoning Ch	CCK 1 to.	Alert level	Alarm level	Action level
Win Win Way	Construction	ı Company	Ltd.		Vibrating Mor	nitoring	2mm/s	2.5mm/s	3mm/s
					#Vibration at large highest Structur	-	5.0mm/s	6.0mm/s	7.5mm/s
			Vibra	tion Re	ecord				
Project Title: Centra	al Police Station C	Conservation &	Revitalization		Project No: WP2	01	11-Aug-2013	3 to	24-Aug-2013
POINT	VM8-1	VM11-1#	VM11-2						
DATE PD/	/(m) mm/s	mm/s	mm/s						
23-Apr-2012 (Initial)	0.212	0.087	0.116						
11-Aug-2013					Sunday				
12-Aug-2013	0.22	0.17	0.56						
13-Aug-2013	0.43	0.53	0.54						
14-Aug-2013		-			Typhoon No.8				
15-Aug-2013	0.19	0.31	0.23						
16-Aug-2013	0.21	0.35	0.40						
17-Aug-2013	0.22	0.37	0.17						
18-Aug-2013					Sunday				
19-Aug-2013	0.96	1.86	0.14						
20-Aug-2013	0.80	0.62	0.34						
21-Aug-2013	0.43	0.51	0.31						
22-Aug-2013	0.19	0.22	0.31						
23-Aug-2013	0.33	0.18	0.21						
24-Aug-2013	0.93	0.96	1.02						

Prepared by : Lo wing yue (Surveyor)

									(Block 8 F	Foundation)	
	5-1-7-1-4			्रच			Monitorin	g Check Pts.		Trigger Level	5
WW 恆		柴上1	主有 限公	(口)			WOINTOTIN	g Check I is.	Alert level	Alarm level	Action level
Win Win Wa	y Const	ruction	Company	Ltd.			Vibrating	Monitoring	2mm/s	2.5mm/s	3mm/s
	•							largest span of ructural level	5.0mm/s	6.0mm/s	7.5mm/s
					Vibrat	ion R	lecord				
Project Title: Cent	tral Police	Station C	onservation &	Revitalizatio	n		Project No: W	VP201	25-Aug-201	3 to	7-Sep-2013
POINT	,	VM8-1	VM11-1#	VM11-2							
DATE P	D/(m)	mm/s	mm/s	mm/s							
23-Apr-2012 (Initia	al)	0.212	0.087	0.116							
25-Aug-2013							Sunday				
26-Aug-2013		0.44	0.41	0.56							
27-Aug-2013		0.16	0.20	0.40							
28-Aug-2013		0.27	0.35	0.20							
29-Aug-2013		1.58	1.40	0.86							
30-Aug-2013		0.46	0.31	0.30							
31-Aug-2013		0.95	1.37	0.45							
1-Sep-2013	•				•		Sunday	-	-		
2-Sep-2013		0.26	0.54	0.51			-				
3-Sep-2013		0.21	0.23	0.29							
4-Sep-2013		0.13	0.31	0.17							
5-Sep-2013		0.31	0.23	0.29							
6-Sep-2013		0.22	0.26	0.37							
7-Sep-2013	7-Sep-2013 0.18 0.22 0.20										

Prepared by : Lo wing yue (Surveyor)


							(Block 8 F	oundation)	
	<u>+7</u> +4-45 一丁:	印七四八			Monitoring (Theck Pts		Trigger Level	5
WW 恆調	《建柴上/	全有限2	くロ		Womtoring	CHECK I IS.	Alert level	Alarm level	Action level
Win Win Way	Construction	n Company	Ltd.		Vibrating M	lonitoring	2mm/s	2.5mm/s	3mm/s
					#Vibration at la highest Struc		5.0mm/s	6.0mm/s	7.5mm/s
			Vibra	tion R	ecord				
Project Title: Central	Police Station C	Conservation &	Revitalization		Project No: WI	2201	8-Sep-2013	3 to	21-Sep-2013
POINT	VM8-1	VM11-1#	VM11-2						
DATE PD/(1	PD/(m) mm/s mm/s mm/s								
23-Apr-2012 (Initial)	0.212	0.087	0.116						
08-Sep-2013					Sunday				
9-Sep-2013	0.54	0.37	0.26						
10-Sep-2013	0.30	0.14	0.26						
11-Sep-2013	0.19	0.56	0.17						
12-Sep-2013	0.38	0.51	0.31						
13-Sep-2013	0.40	0.92	1.47						
14-Sep-2013	0.24	0.18	0.18						
15-Sep-2013					Sunday				
16-Sep-2013	0.50	1.17	1.14						
17-Sep-2013	0.17	0.16	0.35						
18-Sep-2013	0.29	0.37	0.19						
19-Sep-2013	0.29	0.18	0.18						
20-Sep-2013				Pu	ıblic Holiday				
21-Sep-2013	0.18	0.21	0.48						

							(Block 8 F	oundation)	
WW 恆調	卍7井安谷一丁 二	阳七阳八			Monitoring	g Check Pts.		Trigger Levels	
	成建染 上/	全有限2	くロ		WOINTOTINg	check I to.	Alert level	Alarm level	Action level
Win Win Way	Construction	n Company	Ltd.		Vibrating	Monitoring	2mm/s	2.5mm/s	3mm/s
						largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
			Vibra	tion R	ecord				
Project Title: Centra	l Police Station C	Conservation &	Revitalization		Project No: W	/P201	22-Sep-2013	3 to	5-Oct-201
POINT	VM8-1	VM11-1#	VM11-2						
DATE PD/((m) mm/s	mm/s	mm/s						
23-Apr-2012 (Initial)	0.212	0.087	0.116						
22-Sep-2013					Sunday				
23-Sep-2013	0.33	0.26	0.16						
24-Sep-2013	0.15	1.27	0.14						
25-Sep-2013	0.22	0.47	0.55						
26-Sep-2013	0.38	0.25	1.90						
27-Sep-2013	0.34	0.14	0.21						
28-Sep-2013	0.34	0.71	0.29						
29-Sep-2013					Sunday				
30-Sep-2013	0.12	0.21	0.25						
1-Oct-2013				Ρι	inlic Holiday				
2-Oct-2013	0.21	0.28	0.18						
3-Oct-2013	0.26	0.50	0.32						
4-Oct-2013	0.15	0.20	0.37						
5-Oct-2013	0.48	0.23	0.47						


							(Block 8 F	oundation)	
WW 恆調		口士时几			Monitoring	Check Pts		Trigger Level	S
	成建柴 上(主有限2	くロ		Womtoring	CHECK I IS.	Alert level	Alarm level	Action level
Win Win Way	Construction	ı Company	Ltd.		Vibrating	Monitoring	2mm/s	2.5mm/s	3mm/s
						largest span of actural level	5.0mm/s	6.0mm/s	7.5mm/s
			Vibra	ation R	ecord				
Project Title: Centra	l Police Station C	onservation &	Revitalization		Project No: W	P201	6-Oct-2013	3 to	19-Oct-2013
POINT	VM8-1	VM11-1#	VM11-2						
DATE PD/((m) mm/s	mm/s	mm/s						
23-Apr-2012 (Initial)	0.212	0.087	0.116						
06-Oct-2013					Sunday				
7-Oct-2013	0.12	0.21	0.25		5				
8-Oct-2013	0.25	0.37	0.16						
9-Oct-2013	0.38	0.29	0.20						
10-Oct-2013	0.79	0.58	0.25						
11-Oct-2013	0.97	0.67	0.31						
12-Oct-2013	0.45	0.27	0.26						
13-Oct-2013					Sunday				
14-Oct-2013				Pu	ıblic Holiday				
15-Oct-2013	0.25	0.25	0.15						
16-Oct-2013	0.15	0.26	0.42						
17-Oct-2013	0.90	0.15	0.26						
18-Oct-2013	0.26	0.19	0.81						
19-Oct-2013	0.38	0.29	0.20						

								(Block 8 F	Foundation)	
WW 恆	; ≡rt :z:	中谷 丁子	可方时八	(_		Monitorin	g Check Pts.		Trigger Level	S
	同成灭	ま キャー 1	主有 限 2	く口]		Wiemterin	g Check I ts.	Alert level	Alarm level	Action level
Win Win Wa	у Со	nstructior	i Company	Ltd.			Monitoring	2mm/s	2.5mm/s	3mm/s
							largest span of ructural level	5.0mm/s	6.0mm/s	7.5mm/s
				V	ibration R	lecord				
Project Title: Cen	tral Pol	ice Station C	onservation &	Revitalization		Project No: V	VP201	20-Oct-2013	3 to	2-Nov-2013
POINT		VM8-1	VM11-1#	VM11-2						
DATE P	PD/(m)	mm/s	mm/s	mm/s						
23-Apr-2012 (Initi	al)	0.212	0.087	0.116						
20-Oct-2013						Sunday				
21-Oct-2013		0.15	0.26	0.42						
22-Oct-2013		0.24	0.34	0.33						
23-Oct-2013		0.15	0.25	0.75						
24-Oct-2013		0.31	0.16	0.23						
25-Oct-2013		0.26	0.25	0.35						
26-Oct-2013		0.54	0.95	1.85						
27-Oct-2013						Sunday				
28-Oct-2013		0.26	0.29	0.23						
29-Oct-2013		0.16	0.26	0.56						
30-Oct-2013		0.27	0.26	1.83						
31-Oct-2013		0.18	0.92	0.25						
1-Nov-2013		0.19	0.26	0.21						
2-Nov-2013		0.25	0.15	0.45						


Prepared by : Lo wing yue (Surveyor)

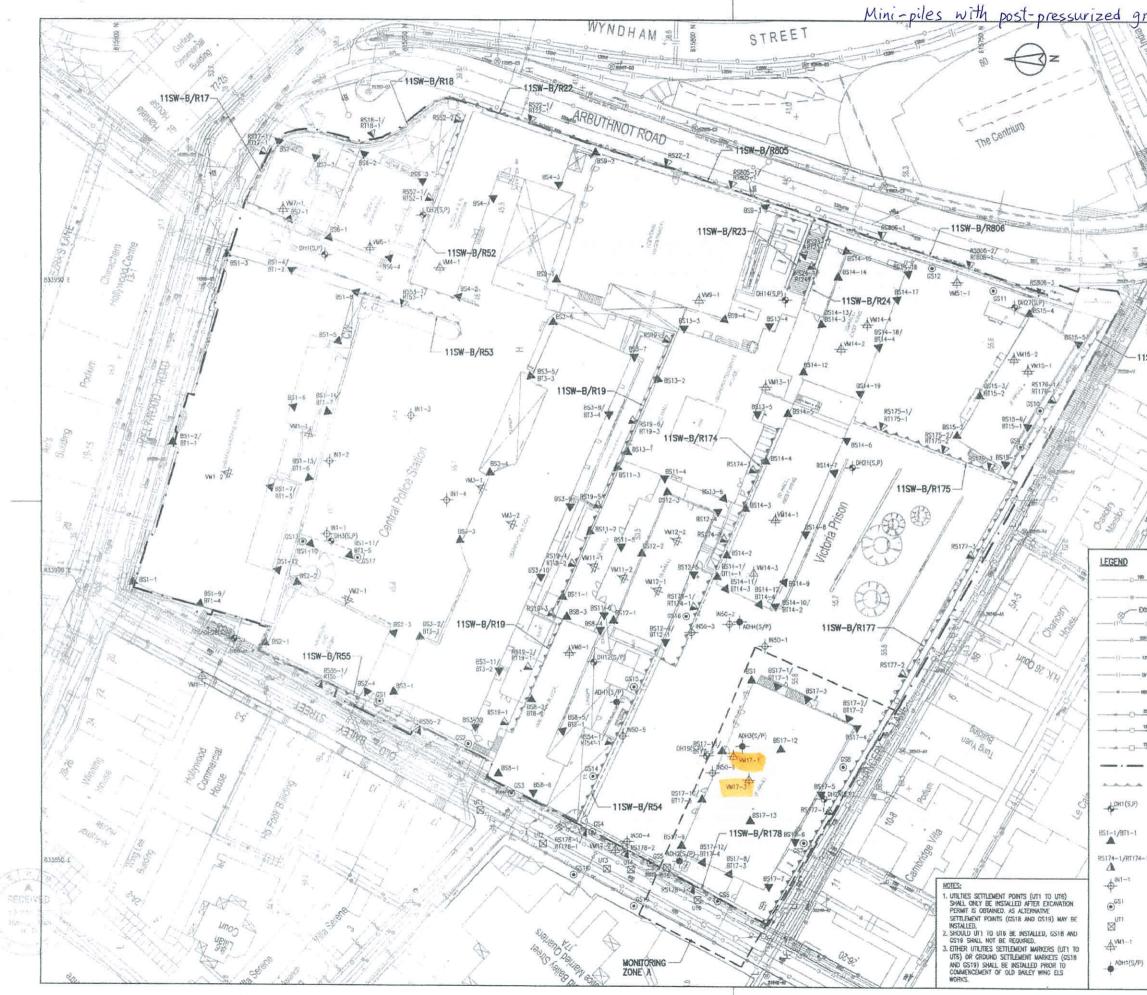


Mini-piles with post-pressurized grout in CDG and steel shear H-piles at Block 1, D SUBMISSION RD SUGMISSION B BD SUSMISSION Shou King Calif 10-1 Plas Approved NG Kun-shing Chief Structural Engineer for BCILLINNG ALTCHORITO 1 9 MAR 2012 lay Plan 索引導 11SW-B/R176 BD SUBMISSION wing Blatux 對顯狀況 ゼロlisist Lonsilion。 主義法以外の内容現象体的指面明白1 remains optionants. 未加有機範疇合同實動阿爾。卡德皮解此機械 出版或如約 的mit Like meansaments 的导致转动器系上重要的 Check and while a4 dimensions on sa 所有尺寸必須加工地領導者參加單核. EXISTING FRESH WATER MAD and an other related scoreigh 素羅是心思與現俗說何喜及其它介張講師一座認識。 EXISTING SALT WATER MAIN STREET LIGHTING NO. 33488-A1 EXISTING TRUES & BORNAN DUSTING STREET LIGHTING CABLE Chent @ 1 EXISTING GAS MAIN 唐馬會文物從直有關公司 Jovan Carl US Listin XUSTING HV ELECTRICITY CASEE EXISTING LY ELECTRICITY CABLE HERZOG&DEMEURON EXISTING TELECOMMUNICATION DUCT (HUTCHISON G OBAL COMMUNICATIONS LIMITED) EXISTING STORMWATER DRAIN ROCCO 许纳严 EXISTING FOUL SEWER PROPOSED FOLL SEWER 三古鮮王的 R. JRP STIE BOUNDAR ARUP EXISTING RETAINING WALL Project 251 CENTRAL POLICE STATION CONSERVATION AND REVITALISATION PROJECT EXISTING DRILLHOLE WITH STANDPIPE/PIEZOMETER Drawing Title EA MONITORING LAYOUT PLAN PROPOSED BUILDING SETTLEMENT POINTS/TRUTMETER PROPOSED RETAINING WALL SETTLEMENT POINTS/TRUTMETER Chann 90 PROPOSED INCLINOMETER TO BE BUILT IN BORIED PILE WALL OR PIPE PILE WALL 1:300041 K.C.Loi 00-0AP209674-G-001 B PROPOSED GROUND SETTLEMENT POINTS PROPOSED UTILITY MONITORING POINTS PROPOSED VERATION MONITORING POINTS PROPOSED ADDITIONAL DRILLHOLE Cat Sis : 00-434P209674-G-601.dwg

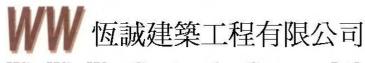


							(Block 17 Four	dation Works)
					Manitari	na Chaola Dta		Trigger Levels	
	₩ / /雨	试 建筑 ⁻	L程有限	1八司	Monitori	ng Check Pts.	Alert level	Alarm level	Action level
	👗 📈	吸生未-	口王日的		Vibratio	on Monitoring	2mm/s	2.5mm/s	3mm/s
Win W	'in Way	Construct	tion Compa	ny Ltd.		Vibration at largest span of highest Structural level		6.0mm/s	7.5mm/s
				Vibrat	ion Record				
Project Title:	Central	Police Station	Conservation	& Revitalization	Project No:	WP201	21-Jul-2013	to	3-Aug-2013
POIN	r I	VM17-1	VM17-3						
DATE	PD/(m)	mm/s	mm/s						
19-Jun-2012	(Initial)	0.13	0.37						
Surveying Date	e								
21-Jul-2013				•	Sunday		•		
22-Jul-2013		0.19	0.16						
23-Jul-2013		0.17	0.25						
24-Jul-2013		0.42	0.30						
25-Jul-2013		0.69	0.58						
26-Jul-2013		0.24	0.30						
27-Jul-2013		0.73	0.37						
28-Jul-2013					Sunday				
29-Jul-2013		0.17	0.25						
30-Jul-2013		0.42	0.30						
31-Jul-2013		0.69	0.58						
1-Aug-2013		0.66	0.91						
2-Aug-2013		0.59	0.15						
3-Aug-2013		0.41	0.66						
Remark									




								(Block 17 Four	ndation Works)
10/11						Manitanina	Chaols Dto		Trigger Levels	
	/ 柄≣	试建筑-	L程有限	1八司		Nionitoring	check Pts.	Alert level	Alarm level	Action level
AA A		败生未-	口生行的	ムリ		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
Win W	in Way	Construct	tion Compa	ny Ltd.			argest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
				Vibra	ation Re	cord				
Project Title:	Central I	Police Station	Conservation	& Revitalization	Pı	oject No: W	P201	4-Aug-2013	to	17-Aug-2013
POINT	ſ	VM17-1	VM17-3							
DATE	PD/(m)	mm/s	mm/s							
19-Jun-2012	(Initial)	0.13	0.37							
Surveying Date										
4-Aug-2013				• •	S	unday				•
5-Aug-2013		0.16	0.40							
6-Aug-2013		0.15	0.16							
7-Aug-2013		0.12	0.29							
8-Aug-2013		0.18	0.43							
9-Aug-2013		0.32	0.22							
10-Aug-2013		0.22	1.16							
11-Aug-2013					S	unday				
12-Aug-2013		0.51	0.67							
13-Aug-2013		0.16	0.14							
14-Aug-2013					,	Гурhoon No.8				
15-Aug-2013		0.17	0.15							
16-Aug-2013		0.45	0.39							
17-Aug-2013		0.15	0.33							
Remark										




								(Block 17 Four	idation Works)
						Manitanin	Chaols Dto		Trigger Levels	
	杨	試 建筑 ⁻	L程有限	1八司		Wionitoring	g Check Pts.	Alert level	Alarm level	Action level
A A A			口生行的	ム山		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
Win W	in Way	Construct	tion Compa	ny Ltd.			argest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
					Vibration 2	Record				
Project Title:	Central	Police Station	Conservation	& Revitalization	on	Project No: W	P201	18-Aug-2013	to	31-Aug-2013
POINT		VM17-1	VM17-3							
DATE	PD/(m)	mm/s	mm/s							
19-Jun-2012	(Initial)	0.13	0.37							
Surveying Date										
18-Aug-2013				•		Sunday				
19-Aug-2013		0.23	0.40							
20-Aug-2013		0.18	0.28							
21-Aug-2013		0.37	0.19							
22-Aug-2013		0.35	0.41							
23-Aug-2013		0.26	0.52							
24-Aug-2013		0.41	0.20							
25-Aug-2013				·		Sunday		·		
26-Aug-2013		0.53	0.41							
27-Aug-2013		0.35	0.35							
28-Aug-2013		0.13	0.27							
29-Aug-2013		0.19	0.90							
30-Aug-2013		0.37	0.34							
31-Aug-2013		0.40	1.13							
Remark										



								(Block 17 Fou	ndation Works)
10/11						Monitoring	g Check Pts.		Trigger Levels	
	小雨	試 建筑 ⁻	L程有限	公司		IVIONILOTINg	g Check Pls.	Alert level	Alarm level	Action level
	L LAT	吸生未-	口生日的	지민		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
Win W	in Way	Construct	tion Compa	ny Ltd.			largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
					Vibration]	Record				
Project Title:	Central	Police Station	Conservation	& Revitalization	on	Project No: W	/P201	1-Sep-2013	to	14-Sep-2013
POINT		VM17-1	VM17-3 #							
DATE	PD/(m)	mm/s	mm/s							
19-Jun-2012	(Initial)	0.13	0.37							
Surveying Date										
1-Sep-2013				r	•	Sunday				
2-Sep-2013		0.24	0.43							
3-Sep-2013		0.22	0.30							
4-Sep-2013		0.20	0.45							
5-Sep-2013		0.15	0.40							
6-Sep-2013		0.22	0.26							
7-Sep-2013		1.41	0.24							
8-Sep-2013			•			Sunday				
9-Sep-2013		1.40	0.61							
10-Sep-2013		0.20	0.17							
11-Sep-2013		0.15	0.15							
12-Sep-2013		0.41	0.26							
13-Sep-2013		0.30	0.40							
14-Sep-2013		0.20	0.27							
Remark										




								(Block 17 Four	ndation Works)
10/11						Monitorino	g Check Pts.		Trigger Levels	
	小石言	试建筑-	L程有限	八司		Womtoning	g Check Pis.	Alert level	Alarm level	Action level
	L LVE	吸生未-	口生日阳	<u>Д</u> Ч]		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
Win Wi	in Way	Construct	tion Compa	ny Ltd.		# Vibration at highest Stru	largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
					Vibration 1	Record				
Project Title:	Central	Police Station	Conservation	& Revitalization	on	Project No: W	P201	15-Sep-2013	to	28-Sep-2013
POINT		VM17-1	VM17-3 #							
DATE	PD/(m)	mm/s	mm/s							
19-Jun-2012 (0.13	0.37							
Surveying Date										
15-Sep-2013			•			Sunday				
16-Sep-2013		0.29	0.29							
17-Sep-2013		0.33	0.15							
18-Sep-2013		0.21	0.43							
19-Sep-2013		0.25	0.32							
20-Sep-2013					Pu	ıblic Holiday				
21-Sep-2013		0.29	0.27							
22-Sep-2013						Sunday				
23-Sep-2013		0.15	0.24							
24-Sep-2013		0.27	0.26							
25-Sep-2013		0.25	0.13							
26-Sep-2013		0.26	0.45							
27-Sep-2013		0.15	0.18							
28-Sep-2013		0.34	0.49							
Remark										



								(Block 17 Four	ndation Works)
10/11						Monitoring	g Check Pts.		Trigger Levels	
WV	杨富	试建筑-	L程有限	公司		Niomioring	g Check Pls.	Alert level	Alarm level	Action level
	L TATE	败生未-	口生日的	지민		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
Win W	in Way	Construct	tion Compa	ny Ltd.			largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
					Vibration 3	Record				
Project Title:	Central	Police Station	Conservation	& Revitalizatio	on	Project No: W	/P201	29-Sep-2013	to	12-Oct-2013
POINT		VM17-1	VM17-3 #							
DATE	PD/(m)	mm/s	mm/s							
19-Jun-2012	(Initial)	0.13	0.37							
Surveying Date										
29-Sep-2013			-	r	•	Sunday				
30-Sep-2013		0.32	0.30							
1-Oct-2013					Pı	ıblic Holiday				
2-Oct-2013		0.43	0.43							
3-Oct-2013		0.62	0.15							
4-Oct-2013		0.41	0.27							
5-Oct-2013		0.25	0.65							
6-Oct-2013					•	Sunday				
7-Oct-2013		0.32	0.30							
8-Oct-2013		0.16	0.23							
9-Oct-2013		0.34	0.37							
10-Oct-2013		0.17	0.34							
11-Oct-2013		0.24	0.38							
12-Oct-2013		0.25	0.12							
Remark										


Prepared by :Lo wing yue (Surveyor)



								(Block 17 Fou	ndation Works)
10/11						Monitorin	g Check Pts.		Trigger Levels	
WV	杨	試 建筑 ⁻	L程有限	公司		Wiomitoring	g Check Pls.	Alert level	Alarm level	Action level
	L LAT	吸生未-	口生日的	Д IJ		Vibration Monitoring		2mm/s	2.5mm/s	3mm/s
Win W	in Way	Construct	tion Compa	ny Ltd.			largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
					Vibration 3	Record				
Project Title:	Central	Police Station	Conservation	& Revitalizatio	on	Project No: W	/P201	13-Oct-2013	to	26-Oct-2013
POINT	POINT VM17-1 VM17-3 #									
DATE	PD/(m)	mm/s	mm/s							
19-Jun-2012	(Initial)	0.13	0.37							
Surveying Date										
13-Oct-2013			-	r		Sunday	-			·
14-Oct-2013					Pı	ıblic Holiday				
15-Oct-2013		0.45	0.75							
16-Oct-2013		0.45	0.12							
17-Oct-2013		0.33	0.46							
18-Oct-2013		0.46	0.82							
19-Oct-2013		0.34	0.37							
20-Oct-2013				·		Sunday	-	-	·	·
21-Oct-2013		0.45	0.12							
22-Oct-2013		0.35	0.26							
23-Oct-2013		0.38	0.34							
24-Oct-2013		0.45	0.19							
25-Oct-2013		0.70	0.25							
26-Oct-2013		0.95	0.27							
Remark										



Gia	/Pipe Pile Walls	3/3053/11 (BLK 17&56) (HW)(S)
UI MIC	B1002 N 001518	F.S.D. Raf. No. 消防虛检索編號
	CH3/	Revision/Submission 修改版/报出 No.编集 Description 說明 Date日期 Approved 審定
1//		- BD SUBMISSION 12/11 JS
21		
15	Shiu King Gourt	
	L-TL II - Frank	
	Ovido	
th	2	
1	E Sta	
1.2	100 100 100	
	100 100 100 100 100 100 100 100 100 100	
404 Hos	of the ofference	Plan Approved
01	E to the t	X
UH.	354	NG Kinlshing Chief Structural Engineer
	· · · · ·	for BUILDING AUTHORITY 2 0 FEB 2012
1 52	Tent	
-115	W-B/R176	Key Plan 索引圖
-41		Store A
	E Association	
T	Podi	
		0000
	AbJA A	
	Miter X	
11	AN ANTIN	BD SUBMISSION
	AN 5	Drawing Status 製圖狀況 - This drawing and the contents herein are the copyright
1 /3)	KWAN KIN KEI Ceng Fismete Mice ton Medistenen structure and enorsen	of relevant consultants. 本關紙及其內容的版框風有調驗問公司所有。 - No part of the drawing and the design contained herein
11	REGISTERED STRUCTORAL ENGRAVE	may be reproduced without the prior written consent of relevant concultance. 未經有關顧問公司書面同意。不得後對此靈經內任何
		內容或設計。 - Do not take measurements directly from this drawing 切勿直接從圓纸上量度尺寸。
0-100	EXISTING FRESH WATER MAIN	 Check and verify all dimensions or site. 所有尺寸必須在工地現場複查及著核。 Read this drawing in conjunction with the specifications
©	EXISTING SALT WATER MAIN ING STREET LIGHTING NO. 33488–41	and all other related drawings. 此關於必須與現格證明書及其它有關關紙一併閱讀。 - Notify the relevant consultants immediately of any
- LAIST	EXISTING STREET LIGHTING CAELE	discrepancy found herein. 如役現內容有任何謬误之處,應立刻通知有調解問公司。
ê) 150	EXISTING GAS MAIN	Client 菜主 賽馬會文物保有有限公司
1330	EXISTING HV ELECTRICITY CABLE	The Jockey Club CPS Limited
1.9	EXISTING LV ELECTRICITY CABLE	
HIZ -	(HUTCHISON GLOBAL COMMUNICATIONS	Conservation Architect
C	LIMITED) EXISTING STORNWATER DRAIN	Executive Architect / AP
150	EXISTING FOUL SEWER	ROCCO
15]	PROPOSED FOUL SEWER	Structural Engineer / RSE E & M Engineer
	SITE BOUNDARY	ARUP ARUP
	EXISTING RETAINING WALL	Project項目 CENTRAL POLICE STATION
,P)	EXISTING DRILLHOLE WITH STANDPIPE/PIEZOMETER	CONSERVATION AND REVITALISATION PROJECT
-1	PROPOSED BUILDING SETTLEMENT POINTS/TILITMETER	Drawing Title 1828 MONITORING LAYOUT PLAN
174-1	PROPOSED RETAINING WALL SETLEMENT	
	PROPOSED INCLINOMETER TO BE BUILT IN	Scale 比例 Drawn 別園 Checked 校时 1:3000A1 K.C.Loi AL
	BORED PILE OR FIPE PILE WALL PROPOSED GROUND SETTLEMENT POINTS	Drawing No 画弦 Revision 你说加 00-0AP209674-G-001 -
	PROPOSED UTILITY MONITORING POINTS	
í,		
0 (0)	PROPOSED VIBRATION MONITORING POINTS	
(S/P)	PROPOSED ADDITIONAL DRILLHOLE	




							a File Walls / File		
14/14/					Monitorin	g Check Pts.		Trigger Levels	
WW 恆	试建筑-	「积右限	八司		IVIOIIIIOIIII	g Check Fis.	Alert level	Alarm level	Action level
	吸生未-	山王日成	. 그 미		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s
Win Win Way	Construct	tion Compa	ny Ltd.			argest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
				Vibration	Record				
Project Title: Central I	Police Station	Conservation	& Revitalizatio	on	Project No: W	/P201	28-Jul-2013	to	10-Aug-2013
POINT	VM8-1	VM11-1	VM11-2	VM12-1	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3
DATE PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s
19-Jun-2012 (Initial)	0.56	0.13	0.19	0.22	0.13	0.21	0.13	0.13	0.37
Surveying Date									
28-Jul-2013		•		•	Sunday	•	• • • • •		•
29-Jul-2013	0.33	0.57	0.47	0.24	0.68	0.66	0.15	0.19	0.16
30-Jul-2013	0.76	0.21	0.17	0.18	0.55	0.78	0.34	0.22	0.24
31-Jul-2013	0.75	0.75	0.20	0.43	0.66	0.17	0.72	0.78	0.53
1-Aug-2013	0.22	0.58	0.23	0.27	0.77	0.28	0.28	0.26	0.47
2-Aug-2013	0.19	0.24	0.26	0.80	0.63	0.17	0.44	0.36	0.20
3-Aug-2013	1.00	0.51	0.16	0.62	0.48	0.69	0.20	0.49	0.51
4-Aug-2013					Sunday	-			
5-Aug-2013	0.38	0.34	0.85	0.41	0.49	0.40	0.16	0.38	0.40
6-Aug-2013	0.82	0.50	1.43	1.01	0.20	0.19	0.15	0.83	0.16
7-Aug-2013	0.16	0.15	0.57	0.16	0.50	0.64	0.12	0.24	0.29
8-Aug-2013	0.19	0.40	0.39	0.40	0.35	0.16	0.18	0.15	0.43
9-Aug-2013	0.34	0.39	0.14	0.27	0.19	0.23	0.32	0.41	0.22
10-Aug-2013	0.35	0.35	0.32	0.19	0.35	0.19	0.22	0.32	1.16
Remark									

(Bored Pile Walls / Pipe Pile Walls at Block 50)



14/14/	1					(Bored Pile Walls / Pipe Pile Walls at Block 50)					
VV VV	個副	成建築]	L程有限	公司		Monitoring	g Check Pts.		Trigger Levels		
						Monitoring	, Check Pis.	Alert level	Alarm level	Action level	
Win Win	ı Way	Construct	tion Compa	ny Ltd.		Vibration Monitoring		2mm/s	2.5mm/s	3mm/s	
							argest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s	
					Vibration	Record					
Project Title: C	Central P	olice Station	Conservation	& Revitalization	on	Project No: W	P201	11-Aug-2013	to	24-Aug-2013	
POINT		VM8-1	VM11-1	VM11-2	VM12-1	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3	
DATE I	PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	
19-Jun-2012 (In	itial)	0.56	0.13	0.19	0.22	0.13	0.21	0.13	0.13	0.37	
Surveying Date											
11-Aug-2013						Sunday					
12-Aug-2013		0.22	0.17	0.56	0.20	0.19	0.14	0.51	0.24	0.67	
13-Aug-2013		0.43	0.53	0.54	0.54	0.61	0.60	0.16	0.64	0.14	
14-Aug-2013			-			Typhoon No.8					
15-Aug-2013		0.19	0.31	0.23	0.40	0.36	0.38	0.17	0.19	0.15	
16-Aug-2013		0.21	0.35	0.40	0.26	0.28	0.14	0.45	0.19	0.39	
17-Aug-2013		0.22	0.37	0.17	0.27	0.32	0.42	0.15	0.35	0.33	
18-Aug-2013	÷			•	•	Sunday	•	•		-	
19-Aug-2013		0.96	1.86	0.14	0.15	0.42	0.16	0.23	0.17	0.40	
20-Aug-2013		0.80	0.62	0.34	0.16	0.14	0.22	0.18	0.68	0.28	
21-Aug-2013		0.43	0.51	0.31	0.59	0.74	0.29	0.37	0.48	0.19	
22-Aug-2013		0.19	0.22	0.31	0.22	0.21	0.19	0.35	0.19	0.41	
23-Aug-2013		0.33	0.18	0.21	0.26	0.68	0.15	0.26	0.22	0.52	
24-Aug-2013		0.93	0.96	1.02	0.15	0.34	0.12	0.41	0.21	0.20	
Remark											



14/1/	/					(Bored Pile Walls / Pipe Pile Walls at Block 50)					
VV V	✔ 個言	成建築	工程有限	公司		Manitaring	Cleast Dta		Trigger Levels		
	-					Niomioring	g Check Pts.	Alert level	Alarm level	Action level	
Win W	'in Way	Construc	tion Compa	ny Ltd.		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s	
							largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s	
					Vibration	Record					
Project Title:	Central P	olice Station	Conservation	& Revitalization	on	Project No: W	/P201	25-Aug-2013	to	7-Sep-2013	
POINT	ſ	VM8-1	VM11-1#	VM11-2	VM12-1#	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3#	
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	
19-Jun-2012	(Initial)	0.56	0.13	0.19	0.22	0.13	0.21	0.13	0.13	0.37	
Surveying Date	,										
25-Aug-2013						Sunday					
26-Aug-2013		0.44	0.41	0.56	0.19	0.20	0.21	0.53	0.45	0.41	
27-Aug-2013		0.16	0.20	0.40	0.35	0.32	0.34	0.35	0.30	0.35	
28-Aug-2013		0.27	0.35	0.20	0.19	1.15	0.18	0.13	0.21	0.27	
29-Aug-2013		1.58	1.40	0.86	0.22	0.17	0.18	0.19	0.16	0.90	
30-Aug-2013		0.46	0.31	0.30	0.34	0.26	0.45	0.37	0.84	0.34	
31-Aug-2013		0.95	1.37	0.45	0.71	0.19	0.39	0.40	0.76	1.13	
1-Sep-2013						Sunday					
2-Sep-2013		0.26	0.54	0.51	0.27	0.39	0.21	0.24	0.61	0.43	
3-Sep-2013		0.21	0.23	0.29	0.15	0.18	0.15	0.22	0.22	0.30	
4-Sep-2013		0.13	0.31	0.17	0.33	0.37	0.17	0.20	0.17	0.45	
5-Sep-2013		0.31	0.23	0.29	0.38	0.39	0.37	0.15	0.28	0.40	
6-Sep-2013		0.22	0.26	0.37	0.31	0.19	0.16	0.22	0.18	0.26	
7-Sep-2013		0.18	0.22	0.20	0.29	0.18	0.15	1.41	0.14	0.24	
Remark											




1 / / / / 恆誠建築工程有限公司		Monitoring	g Check Pts.		Trigger Levels	
		WOINTOTINg	g Check Fis.	Alert level	Alarm level	Action level
Win Win Way Construction Company Ltd.		Vibration Monitoring		2mm/s	2.5mm/s	3mm/s
			largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s
	Vibration	Record				
Project Title: Central Police Station Conservation & Revital	ization	Project No: W	/P201	8-Sep-2013	to	21-Sep-2013
POINT VM8-1 VM11-1# VM11-	-2 VM12-1#	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3 #
DATE PD/(m) mm/s mm/s mm/s	s mm/s	mm/s	mm/s	mm/s	mm/s	mm/s
19-Jun-2012 (Initial) 0.56 0.13 0.19	0.22	0.13	0.21	0.13	0.13	0.37
Surveying Date						
8-Sep-2013	÷	Sunday			-	r.
9-Sep-2013 0.54 0.37 0.26	0.28	1.70	0.31	1.40	0.15	0.61
10-Sep-2013 0.30 0.14 0.26	0.27	0.23	0.18	0.20	0.42	0.17
11-Sep-2013 0.19 0.56 0.17	0.18	0.24	0.23	0.15	0.30	0.15
12-Sep-2013 0.38 0.51 0.31	0.32	0.14	0.18	0.41	0.40	0.26
13-Sep-2013 0.40 0.92 1.47	0.47	0.66	0.79	0.30	0.27	0.40
14-Sep-2013 0.24 0.18 0.18	0.16	0.35	0.41	0.20	0.17	0.27
15-Sep-2013	·	Sunday				·
16-Sep-2013 0.50 1.17 1.14	0.48	1.14	0.46	0.29	0.46	0.29
17-Sep-2013 0.17 0.16 0.35	0.17	0.19	0.19	0.33	0.24	0.15
18-Sep-2013 0.29 0.37 0.19	0.30	0.23	0.26	0.21	0.23	0.43
19-Sep-2013 0.29 0.18 0.18	0.17	0.34	0.38	0.25	0.44	0.32
20-Sep-2013]	Public Holiday		· · · · · · · · · · · · · · · · · · ·		· · · · · · · · · · · · · · · · · · ·
21-Sep-2013 0.18 0.21 0.48	0.24	1.97	0.36	0.29	0.59	0.27
Remark						

(Bored Pile Walls / Pipe Pile Walls at Block 50)




14/1/	/					(Bored Pile Walls / Pipe Pile Walls at Block 50)						
VV V	✔ 個記	成建築	L程有限	公司		Monitorin	g Check Pts.		Trigger Levels			
	-					IVIOIIItOTIII§	g Check Pls.	Alert level	Alarm level	Action level		
Win W	'in Way	Construc	tion Compa	ny Ltd.		Vibration Monitoring		2mm/s	2.5mm/s	3mm/s		
							largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s		
					Vibration	Record						
Project Title:	Central P	olice Station	Conservation	& Revitalization	on	Project No: W	/P201	22-Sep-2013	to	5-Oct-2013		
POINT	ſ	VM8-1	VM11-1#	VM11-2	VM12-1#	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3 #		
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s		
19-Jun-2012	(Initial)	0.56	0.13	0.19	0.22	0.13	0.21	0.13	0.13	0.37		
Surveying Date	,											
22-Sep-2013						Sunday						
23-Sep-2013		0.33	0.26	0.16	0.22	0.16	0.16	0.15	0.17	0.24		
24-Sep-2013		0.15	1.27	0.14	0.23	0.16	0.16	0.27	0.45	0.26		
25-Sep-2013		0.22	0.47	0.55	0.26	0.17	0.25	0.25	0.34	0.13		
26-Sep-2013		0.38	0.25	1.90	0.28	0.16	0.26	0.26	0.40	0.45		
27-Sep-2013		0.34	0.14	0.21	0.15	0.15	0.14	0.15	0.21	0.18		
28-Sep-2013		0.34	0.71	0.29	0.20	0.32	1.20	0.34	0.19	0.49		
29-Sep-2013				·		Sunday						
30-Sep-2013		0.12	0.21	0.25	0.16	0.13	0.25	0.32	0.22	0.30		
1-Oct-2013					Р	ublic Holiday						
2-Oct-2013		0.21	0.28	0.18	0.40	0.18	0.19	0.43	0.50	0.43		
3-Oct-2013		0.26	0.50	0.32	0.25	0.15	0.58	0.62	0.26	0.15		
4-Oct-2013		0.15	0.20	0.37	0.57	0.29	0.30	0.41	0.64	0.27		
5-Oct-2013		0.48	0.23	0.47	0.30	0.34	0.35	0.25	0.39	0.65		
Remark												



14/1/	/					(Bored Pile Walls / Pipe Pile Walls at Block 50)						
VV V	✔ 個言	成建築「	L程有限	公司		Manitaring	Chaols Dto		Trigger Levels			
	*					IVIONITOLIUS	g Check Pts.	Alert level	Alarm level	Action level		
Win W	'in Way	Construc	tion Compa	ny Ltd.		Vibration Monitoring		2mm/s	2.5mm/s	3mm/s		
							largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s		
					Vibration	Record						
Project Title:	Central P	olice Station	Conservation	& Revitalization	on	Project No: W	/P201	6-Oct-2013	to	19-Oct-2013		
POINT	ſ	VM8-1	VM11-1#	VM11-2	VM12-1#	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3 #		
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s		
19-Jun-2012	(Initial)	0.56	0.13	0.19	0.22	0.13	0.21	0.13	0.13	0.37		
Surveying Date	e											
6-Oct-2013						Sunday						
7-Oct-2013		0.12	0.21	0.25	0.16	0.13	0.25	0.32	0.22	0.30		
8-Oct-2013		0.25	0.37	0.16	0.57	0.27	0.24	0.16	0.38	0.23		
9-Oct-2013		0.38	0.29	0.20	0.43	0.23	0.29	0.34	0.26	0.37		
10-Oct-2013		0.79	0.58	0.25	0.18	0.26	0.15	0.17	0.18	0.34		
11-Oct-2013		0.97	0.67	0.31	0.21	0.43	0.26	0.24	0.90	0.38		
12-Oct-2013		0.45	0.27	0.26	0.75	0.47	0.15	0.25	0.26	0.12		
13-Oct-2013						Sunday						
14-Oct-2013					F	ublic Holiday						
15-Oct-2013		0.25	0.25	0.15	0.25	0.68	0.29	0.45	0.25	0.75		
16-Oct-2013		0.15	0.26	0.42	0.19	0.37	0.52	0.45	0.25	0.12		
17-Oct-2013		0.90	0.15	0.26	0.76	0.16	0.35	0.33	0.16	0.46		
18-Oct-2013		0.26	0.19	0.81	0.35	1.02	1.11	0.46	0.73	0.82		
19-Oct-2013		0.38	0.29	0.20	0.43	0.23	0.29	0.34	0.26	0.37		
Remark												



14/1	/					(Bored Pile Walls / Pipe Pile Walls at Block 50)					
VV V	✔ 個言	成建築	L程有限	公司		Manitarina	Cleastr Dta		Trigger Levels		
	-					Womtoning	g Check Pts.	Alert level	Alarm level	Action level	
Win W	'in Way	Construc	tion Compa	ny Ltd.		Vibration	Monitoring	2mm/s	2.5mm/s	3mm/s	
							largest span of uctural level	5.0mm/s	6.0mm/s	7.5mm/s	
					Vibration	Record					
Project Title:	Central P	olice Station	Conservation	& Revitalization	on	Project No: W	/P201	20-Oct-2013	to	2-Nov-2013	
POINT	r	VM8-1	VM11-1#	VM11-2	VM12-1#	VM12-2	VM14-3	VM17-1	VM17-2	VM17-3 #	
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	mm/s	
19-Jun-2012	(Initial)	0.56	0.13	0.19	0.22	0.13	0.21	0.13	0.13	0.37	
Surveying Date	e										
20-Oct-2013						Sunday	•				
21-Oct-2013		0.15	0.26	0.42	0.19	0.37	0.52	0.45	0.25	0.12	
22-Oct-2013		0.24	0.34	0.33	0.29	0.38	0.13	0.35	0.32	0.26	
23-Oct-2013		0.15	0.25	0.75	0.35	0.46	0.25	0.38	0.24	0.34	
24-Oct-2013		0.31	0.16	0.23	0.70	0.15	0.16	0.45	0.31	0.19	
25-Oct-2013		0.26	0.25	0.35	0.15	0.26	0.48	0.70	0.81	0.25	
26-Oct-2013		0.54	0.95	1.85	0.25	0.45	0.98	0.95	0.21	0.27	
27-Oct-2013						Sunday					
28-Oct-2013		0.26	0.29	0.23	0.20	0.54	0.64	0.30	0.15	0.41	
29-Oct-2013		0.16	0.26	0.56	0.40	0.34	0.19	0.39	0.37	0.32	
30-Oct-2013		0.27	0.26	1.83	1.53	0.62	0.36	0.23	0.19	0.22	
31-Oct-2013		0.18	0.92	0.25	0.49	0.20	0.40	0.18	0.16	0.25	
1-Nov-2013		0.19	0.26	0.21	0.35	0.22	0.18	0.48	0.26	0.37	
2-Nov-2013		0.25	0.15	0.45	0.73	0.15	1.10	0.86	0.95	0.25	
Remark											

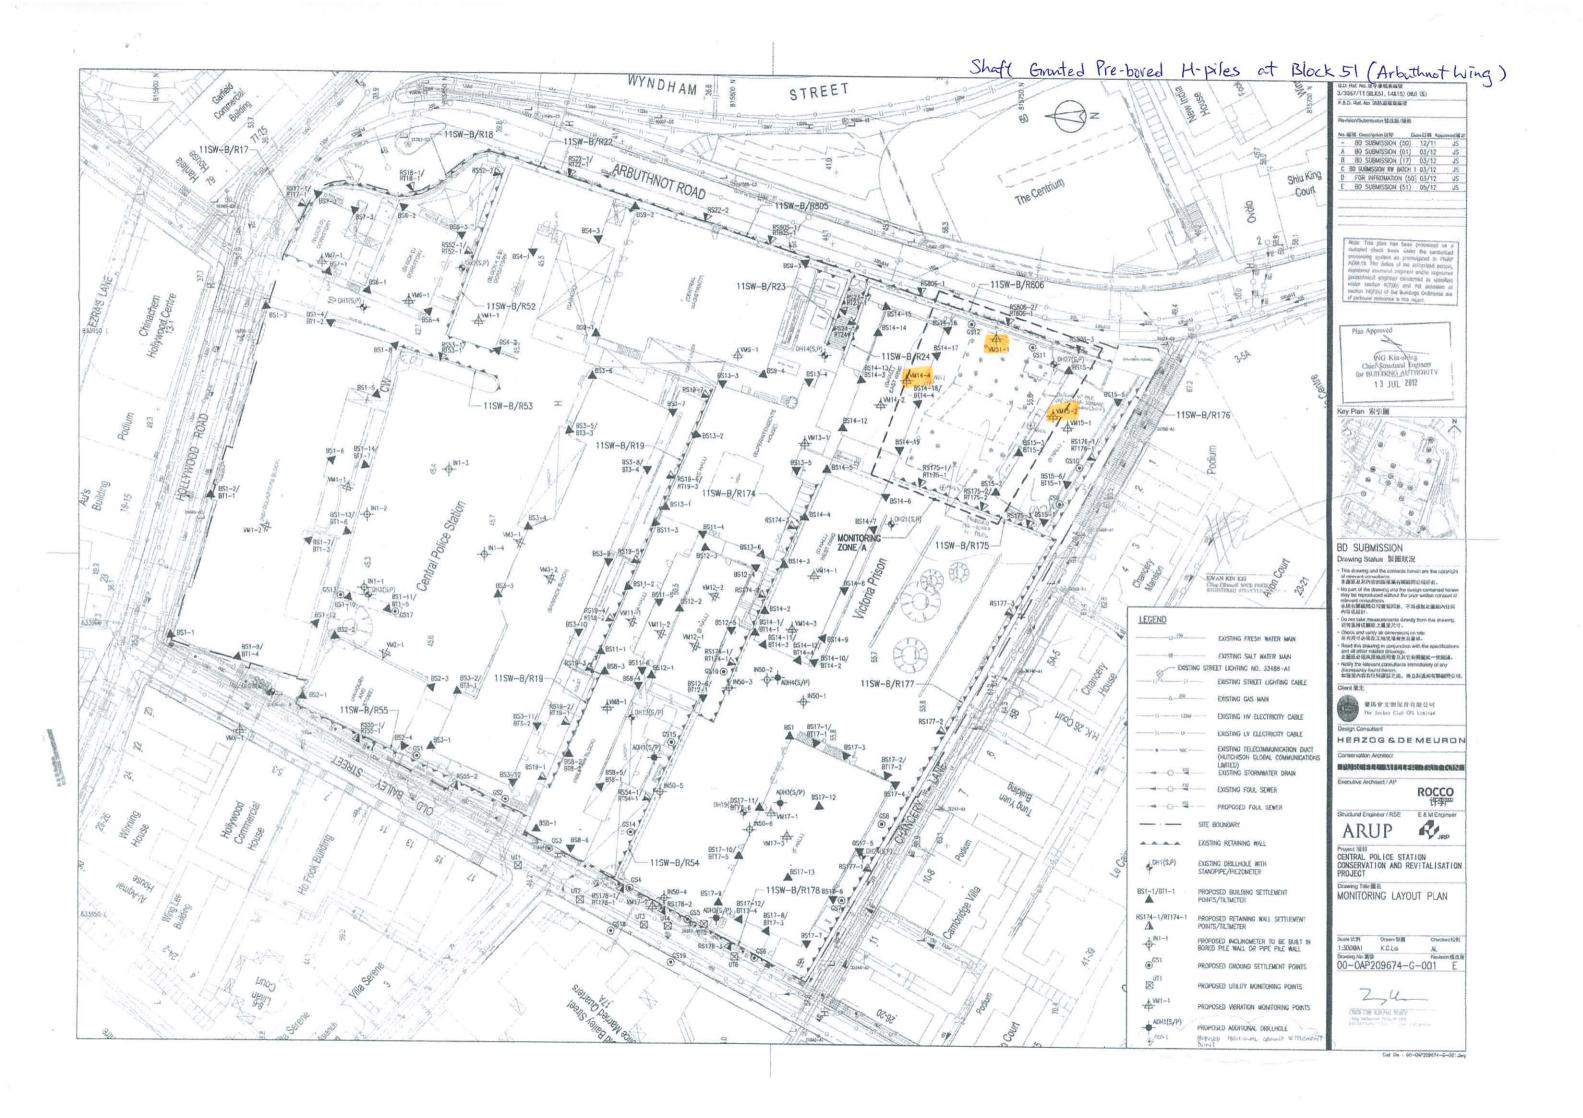

		1.					(Sha	ft Grouted Pre-bor	ed H-piles at B	lock 51)
WW	板計	2曲按丁	程有限公	1 크		Manitarian C	1 1 . Dt.		Trigger Levels	
AA AA	也顽) 建 架 上	任月1121	之山		Monitoring C	neck Pis.	Alert level	Alarm level	Action level
5 6						Vibrating Mc	nitoring	2mm/s	2.5mm/s	3mm/s
win win	way C	onstructio	on Company	Ltd.						
				Vi	bration	Record				
Project Title	: Central	Police Station	n Conservation	& Revitalization	Proje	ct No: WP201		21-Jul-2013	to	3-Aug-2013
POINT		VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
21-Jul-2013						Sunday				
22-Jul-2013		0.53	0.25	0.27						
23-Jul-2013		0.69	0.72	0.19						
24-Jul-2013		0.51	0.61	0.59						
25-Jul-2013		0.77	0.21	0.20					-	
26-Jul-2013		0.42	0.63	0.28						
27-Jul-2013		0.40	0.18	0.78						
28-Jul-2013						Sunday				
29-Jul-2013		0.14	0.88	0.25						
30-Jul-2013		1.04	0.37	0.82						
31-Jul-2013		0.71	0.74	0.69						
1-Aug-2013		0.17	0.20	0.57						
2-Aug-2013		0.19	0.23	0.19						
3-Aug-2013		0.69	0.52	0.84						
Remarks										

 \mathbf{r}

K

Prepared by : Lo wing yue (Surveyor)

							(Shafi	Grouted Pre-bore	ed H-piles at B	lock 51)
WW	相對	油饼丁	程有限公	1 হা		Manitoring Ch	a alv Dta		Trigger Levels	
AN AN	旦初	建杂上	任月1121	ノロ		Monitoring Ch	eck Pts.	Alert level	Alarm level	Action level
197 I B 197 191						Vibrating Mon	nitoring	2mm/s	2.5mm/s	3mm/s
	way c	onstructio	on Company		ration 2	Record				
Project Title	: Central	Police Station	n Conservation	& Revitalization	Proje	ct No: WP201		4-Aug-2013	to	17-Aug-2013
	T									
POINT		VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						·
4-Aug-2013						Sunday				
5-Aug-2013		0.53	0.42	0.18						
6-Aug-2013		0.18	0.20	0.27						
7-Aug-2013		0.26	0.21	0.17						
8-Aug-2013		0.21	0.24	0.13						
9-Aug-2013		0.44	0.26	0.16						
10-Aug-2013		0.18	1.33	0.27						· · · · · · · · · · · · · · · · · · ·
11-Aug-2013						Sunday				
12-Aug-2013		0.16	0.26	0.33						
13-Aug-2013		0.26	0.33	0.39						
14-Aug-2013						Typhoon No.8				
15-Aug-2013		0.24	0.40	0.27						
16-Aug-2013		0.29	0.30	0.24						
17-Aug-2013		0.15	0.37	0.50						
Remarks										

M

Prepared by : Lo wing yue (Surveyor)

							(Sha	aft Grouted Pre-bore	ed H-piles at B	lock 51)
	ोट द ा	治神袋子	和七四7	र — ।					Trigger Levels	
AA AA	也动	(建杂上	程有限公	ンロ		Monitoring	Check Pts.	Alert level	Alarm level	Action level
						Vibrating N	Monitoring	2mm/s	2.5mm/s	3mm/s
win win	Way (Constructio	n Company	⁷ Ltd.						
				Vib	ration I	Record				
Project Title:	Central	Police Station	n Conservation	& Revitalization	et No: WP201		18-Aug-2013	to	31-Aug-2013	
POINT		VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
18-Aug-2013			-			Sunday				
19-Aug-2013		0.37	0.40	0.30						
20-Aug-2013		0.31	0.18	0.41						
21-Aug-2013		0.23	0.49	0.26						
22-Aug-2013		0.19	0.15	0.16						
23-Aug-2013		0.16	0.40	0.19						
24-Aug-2013		0.15	0.35	0.28						
25-Aug-2013						Sunday				
26-Aug-2013		0.42	0.38	0.50						
27-Aug-2013		0.16	0.22	0.16						
28-Aug-2013		0.27	0.35	0.18						
29-Aug-2013		0.32	0.15	0.27						
30-Aug-2013		0.32	0.38	1.41						
31-Aug-2013		0.30	0.36	0.30						
Remarks										

							(Shaf	t Grouted Pre-bore	ed H-piles at B	lock 51)
	्राम् सम्बन्ध	2舟锛丁	和方[][]/	र च	Г		D		Trigger Levels	
	且誠	建染上	程有限公	乙山		Monitoring Check	Pts.	Alert level	Alarm level	Action level
						Vibrating Monitori	ng	2mm/s	2.5mm/s	3mm/s
win win	Way C	onstructio	n Company	Z Ltd.						
				Vibr	ration R	ecord				
Project Title:	Central	Police Station	Conservation	& Revitalization	Project	No: WP201		1-Sep-2013	to	14-Sep-2013
POINT	,	VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
1-Sep-2013						Sunday				-
2-Sep-2013		0.45	0.31	0.35						
3-Sep-2013		0.15	1.41	0.34						
4-Sep-2013		0.18	0.22	0.24						
5-Sep-2013		0.52	0.61	0.26						
6-Sep-2013		0.14	0.29	0.95						
7-Sep-2013		0.18	0.26	0.19						
8-Sep-2013						Sunday				
9-Sep-2013		0.15	0.23	0.34						
10-Sep-2013		0.14	0.20	0.26						
11-Sep-2013		0.21	0.16	0.18						
12-Sep-2013		0.15	0.22	0.35						
13-Sep-2013		0.46	0.41	0.54						
14-Sep-2013		0.21	0.22	0.16						
Remarks										

							(Sha	ft Grouted Pre-bore	ed H-piles at B	lock 51)
	्राम् स्ट्रिस्	と神欲す	和七四/	र 🖃			C1 1 D		Trigger Levels	
VV VV	也动	《建榮上	程有限公	ンロ		Monitoring	Check Pts.	Alert level	Alarm level	Action level
						Vibrating N	Ionitoring	2mm/s	2.5mm/s	3mm/s
win win	way (Constructio	n Company	7 Ltd.						
				Vibi	ration 1	Record				
Project Title:	Central	Police Station	n Conservation	& Revitalization	Projec	et No: WP201		15-Sep-2013	to	28-Sep-2013
POINT		VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
15-Sep-2013			-			Sunday				
16-Sep-2013		0.21	0.30	1.04						
17-Sep-2013		0.26	0.18	0.42						
18-Sep-2013		0.15	0.27	0.29						
19-Sep-2013		0.64	0.31	0.15						
20-Sep-2013						Public Holiday				
21-Sep-2013		0.30	0.27	0.18						
22-Sep-2013						Sunday				
23-Sep-2013		0.15	0.28	0.16						
24-Sep-2013		0.14	0.26	0.20						
25-Sep-2013		0.15	0.29	0.19						
26-Sep-2013		0.27	0.36	0.64						
27-Sep-2013		0.23	0.78	0.18						
28-Sep-2013		0.23	1.04	0.32						
Remarks										

							(Sha	aft Grouted Pre-bore	ed H-piles at B	lock 51)
	\ट मि	さかす	和古时,	<u>र</u> —ा			1. D		Trigger Levels	
AA AA	因动	(建築上	程有限公	ンロ		Monitoring Ch	eck Pts.	Alert level	Alarm level	Action level
XX7* XX7*						Vibrating Mon	nitoring	2mm/s	2.5mm/s	3mm/s
win win	Way C	Constructio	n Company	Z Ltd.						
				Vibi	ration 1	Record				
Project Title:	Central	Police Station	n Conservation	& Revitalization	Projec	et No: WP201		29-Sep-2013	to	12-Oct-2013
POINT		VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
29-Sep-2013			-			Sunday				
30-Sep-2013		0.35	0.30	0.35						
1-Oct-2013			-	· · ·	Pu	blic Holiday				
2-Oct-2013		0.39	0.22	0.22						
3-Oct-2013		0.25	0.25	0.26						
4-Oct-2013		0.42	0.28	0.29						
5-Oct-2013		0.26	0.25	0.15						
6-Oct-2013						Sunday				
7-Oct-2013		0.16	0.46	0.25						
8-Oct-2013		0.48	0.36	0.45						
9-Oct-2013		0.32	0.25	0.32						
10-Oct-2013		0.28	0.78	0.25						
11-Oct-2013		0.60	0.25	0.25						
12-Oct-2013		0.25	0.46	0.26						
Remarks										

							(Sha	aft Grouted Pre-bore	ed H-piles at E	lock 51)
	() () () ()	7.事练了	10七时)	ז ⊐ ו			(1 1 D)		Trigger Levels	
AA AA	也誠)建染上	程有限公	ンロ		Monitoring	Check Pts.	Alert level	Alarm level	Action level
						Vibrating N	Ionitoring	2mm/s	2.5mm/s	3mm/s
win win	way C	onstructio	n Company	⁷ Ltd.						
				Vibr	ration]	Record				
Project Title	: Central	Police Statior	n Conservation	& Revitalization	Projec	ct No: WP201		13-Oct-2013	to	26-Oct-2013
POINT	ſ	VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
13-Oct-2013						Sunday				
14-Oct-2013					Pu	blic Holiday				
15-Oct-2013		0.22	0.35	0.61						
16-Oct-2013		0.75	0.26	0.21						
17-Oct-2013		0.42	0.20	0.46						
18-Oct-2013		0.79	0.60	0.25						
19-Oct-2013		0.75	0.26	0.21						
20-Oct-2013						Sunday				
21-Oct-2013		0.85	0.25	0.36						
22-Oct-2013		0.26	0.52	1.76						
23-Oct-2013		0.57	0.15	0.57						
24-Oct-2013		0.17	0.40	0.66						
25-Oct-2013		0.54	0.25	0.61						
26-Oct-2013		0.27	0.89	0.56						
Remarks										

							(Sha	aft Grouted Pre-bor	ed H-piles at B	lock 51)
	版式专作	7事练了	10-17月7	٦ <u></u>			Cl. 1 D.		Trigger Levels	
VV VV	但颉)建柴上	程有限公	ンリ		Monitoring	g Check Pts.	Alert level	Alarm level	Action level
						Vibrating	Monitoring	2mm/s	2.5mm/s	3mm/s
win win	Way C	onstructio	n Company		ration 1	Record				
Project Title	: Central	Police Statior	Conservation	& Revitalization		et No: WP201		27-Oct-2013	to	9-Nov-2013
POINT		VM14-4	VM15-2	VM51-1						
DATE	PD/(m)	mm/s	mm/s	mm/s						
03-Dec-2012	(Initial)	0.14	0.21	0.3						
27-Oct-2013						Sunday	•			
28-Oct-2013		0.20	0.59	0.26						
29-Oct-2013		0.21	0.36	0.23						
30-Oct-2013		0.35	0.20	0.21						
31-Oct-2013		0.19	0.46	0.37						
1-Nov-2013		0.37	0.26	0.29						
2-Nov-2013		0.16	0.54	0.24						
3-Nov-2013										
4-Nov-2013		0.22	0.49	0.29						
5-Nov-2013										
6-Nov-2013										
7-Nov-2013										
8-Nov-2013										
9-Nov-2013										
Remarks	I T									

Annex M

Records of Vibration Monitoring for Other Construction Works



							(Block 14 Str	uctural A&A)
	ोट क ी	2中统丁	和古时	र चा				Trigger Levels	
AA AA	也动	建染上	程有限公	ンロ		Monitoring Check Pts.	Alert level	Alarm level	Action level
						Vibrating Monitoring	2mm/s	2.5mm/s	3mm/s
	. way C	onstructio	n Company	/ Lta.	Vibration	Record			
Project Title	: Central	Police Station	Conservation	& Revitalizati	ion Proje	ect No: WP201	28-Jul-2013	to	10-Aug-2013
POINT	[VM14-1	VM14-2	VM14-3	VM14-4				
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s				
19-Nov-12 (Initial)	0.103	0.112	0.147	0.136				
28-Jul-2013						Sunday			
29-Jul-2013		0.64	0.66	0.66	0.14				
30-Jul-2013		0.29	0.78	0.78	1.04				
31-Jul-2013		0.16	0.17	0.17	0.71				
1-Aug-2013		0.49	0.28	0.28	0.17				
2-Aug-2013		0.39	0.17	0.17	0.14				
3-Aug-2013		0.37	0.51	0.69	0.16				
4-Aug-2013						Sunday			
5-Aug-2013		0.30	0.16	0.40	0.53				
6-Aug-2013		0.51	0.27	0.19	0.18				
7-Aug-2013		0.15	0.19	0.64	0.26				
8-Aug-2013		0.30	0.46	0.16	0.21				
9-Aug-2013		0.23	0.18	0.23	0.44				
10-Aug-2013		0.20	0.62	0.19	0.18				
Remarks									

14/14		: እንት ሎሎ	4 F4H	h-t p-tt				(Block 14 Stru	uctural A&A	
VV VI	/ 恆		工程有降	 		Monitoring (Check Pts.		Trigger Levels	
Win W	in War	Constant	tion Comm	any I 4J				Alert level	Alarm level	Action level
VVIII VV.	ш vvay	Construe	ction Comp	bany Lua.		Vibration M		2mm/s	2.5mm/s	3mm/s
						# Vibration at la		5.0mm/s	6.0mm/s	7.5mm/s
						highest Struc	ctural level	0.011111/0	0.011111/5	, .e min 5
					Vibration	Record				
Project Title:	: Central	Police Station	n Conservation	& Revitalization	on Proje	ct No: WP201		11-Aug-2013	to	24-Aug-2013
						1				
POINT		VM14-1#	VM14-2 #	VM14-3	VM14-4					
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s					
19-Nov-12 (1	Initial)	0.103	0.112	0.147	0.136					
11-Aug-2013						Sunday				
12-Aug-2013		0.18	0.14	0.14	0.16					
13-Aug-2013		0.54	0.33	0.60	0.26					
14-Aug-2013						Typhoon No.8				
15-Aug-2013		0.68	0.24	0.38	0.24					
16-Aug-2013		0.15	0.19	0.14	0.29					
17-Aug-2013		0.64	0.35	0.42	0.15					
18-Aug-2013						Sunday				
19-Aug-2013		0.24	0.14	0.16	0.37					
20-Aug-2013		0.17	0.15	0.22	0.31					
21-Aug-2013		0.68	0.37	0.29	0.23					
22-Aug-2013		0.31	0.23	0.19	0.19					
23-Aug-2013		0.56	0.16	0.15	0.16					
24-Aug-2013		0.16	0.23	0.12	0.15					
Remarks										


14/14	1	.	<u>→ 1,[] / / /</u>	비지 ㅋ				(Block 14 Stru	,	
VV VI	四日	誠建梁	工程有降	民公可		Monitoring C	heck Pts.		Trigger Levels	
Win Wi	in Wax	Construe	ction Comp	any I td				Alert level	Alarm level	Action level
	ui way	Construc	cion comp	ally Ltu.		Vibration Mc		2mm/s	2.5mm/s	3mm/s
						# Vibration at lar, highest Struct		5.0mm/s	6.0mm/s	7.5mm/s
					Vibration	Record				
Project Title:	Central	Police Station	n Conservation	& Revitalizati	on Proje	ct No: WP201		25-Aug-2013	to	7-Sep-2013
						<u>г</u>		1		
POINT		VM14-1#	VM14-2 #	VM14-3	VM14-4					
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s					
19-Nov-12 (l	nitial)	0.103	0.112	0.147	0.136					
25-Aug-2013						Sunday				
26-Aug-2013		0.18	0.33	0.21	0.42					
27-Aug-2013		0.18	0.41	0.34	0.16					
28-Aug-2013		0.32	0.37	0.18	0.27					
29-Aug-2013		0.29	0.39	0.18	0.32					
30-Aug-2013		0.37	0.26	0.45	0.32					
31-Aug-2013		0.44	0.40	0.39	0.30					
1-Sep-2013						Sunday				
2-Sep-2013		0.32	0.28	0.21	0.45					
3-Sep-2013		0.41	0.24	0.15	0.15					
4-Sep-2013		0.37	0.51	0.17	0.18					
5-Sep-2013		0.17	0.47	0.37	0.52					
6-Sep-2013		0.15	0.20	0.16	0.14					
7-Sep-2013		0.16	0.32	0.15	0.18					
Remarks										

14/14	/ .t. 	<u>. ኮንቲሉ</u>	<u>→≁111</u> →17					(Block 14 Str	uctural A&A	
<i>VV VV</i>	何日	誠建梁	工程有限	民公司		Monitoring (Check Pts.		Trigger Levels	
Win Wi	n Wax	Construe	ction Comp	ony I td				Alert level	Alarm level	Action level
	II way	Construe	cuon comp	any Liu.		Vibration M		2mm/s	2.5mm/s	3mm/s
						# Vibration at la highest Struc		5.0mm/s	6.0mm/s	7.5mm/s
					Vibration	Record				
Project Title:	Central	Police Station	n Conservation	& Revitalizati	on Proje	ct No: WP201		8-Sep-2013	to	21-Sep-2013
POINT		VM14-1#	VM14-2 #	VM14-3	VM14-4					
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s					
19-Nov-12 (In	nitial)	0.103	0.112	0.147	0.136					
8-Sep-2013						Sunday				
9-Sep-2013		0.74	0.72	0.31	0.15					
10-Sep-2013		0.20	0.46	0.18	0.14					
11-Sep-2013		0.29	0.16	0.23	0.21					
12-Sep-2013		0.18	0.22	0.18	0.15					
13-Sep-2013		0.36	1.15	0.79	0.46					
14-Sep-2013		0.40	0.18	0.41	0.21					
15-Sep-2013						Sunday				
16-Sep-2013		0.26	0.24	0.46	0.21					
17-Sep-2013		0.29	0.41	0.19	0.26					
18-Sep-2013		0.59	0.44	0.26	0.15					
19-Sep-2013		0.86	0.15	0.38	0.64					
20-Sep-2013					Р	ublic Holiday				
21-Sep-2013		0.86	0.39	0.36	0.30					
Remarks										

14/1/		<u>計7</u> 井公东	┯┲┲	비지ㅋ				(Block 14 Str	,	1
AA A	1 <u>1</u> 2		工程有降	农公 可		Monitoring Check	Pts.	Alert level	Trigger Levels Alarm level	Action level
Win W	in Way	. Constru	ction Comp	oanv Ltd.		Vibration Monitori	na	2mm/s	2.5mm/s	3mm/s
						# Vibration at largest s		211111/8	2.311111/8	511111/8
						highest Structural le	-	5.0mm/s	6.0mm/s	7.5mm/s
					Vibration	Record				
Project Title	: Central	Police Station	n Conservation	& Revitalizati	on Proje	ct No: WP201		22-Sep-2013	to	5-Oct-2013
POIN	r	VM14-1#	VM14-2 #	VM14-3	VM14-4					
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s					
19-Nov-12 (Initial)	0.103	0.112	0.147	0.136					
22-Sep-2013				•		Sunday				
23-Sep-2013		0.13	0.45	0.16	0.15					
24-Sep-2013		0.15	0.26	0.16	0.14					
25-Sep-2013		0.25	0.26	0.25	0.15					
26-Sep-2013		0.22	0.31	0.26	0.27					
27-Sep-2013		0.27	0.30	0.14	0.23					
28-Sep-2013		0.35	0.63	1.20	0.23					
29-Sep-2013						Sunday		· · ·		
30-Sep-2013		0.23	0.42	0.25	0.35					
1-Oct-2013					Р	ublic Holiday				
2-Oct-2013		0.21	0.21	0.19	0.39					
3-Oct-2013		0.15	0.26	0.58	0.25					
4-Oct-2013		0.16	0.37	0.30	0.42					
5-Oct-2013		0.25	0.16	0.35	0.26					
Remarks										

LA/LA	/	→ N →++ &+&+						(Block 14 Str	uctural A&A))
VVV	/ 恆	 誠建染	工程有降	艮公 司		Monitoring Ch	neck Pts		Trigger Levels	
Win W								Alert level	Alarm level	Action level
win w	in way	Construc	ction Comp	bany Ltd.		Vibration Monitoring		2mm/s	2.5mm/s	3mm/s
						# Vibration at larg	-	5.0mm/s	6.0mm/s	7.5mm/s
						highest Structu	iral level	0.0111115	0.011111/0	,.emm.s
					Vibration	Record				
Project Title:	: Central	Police Station	n Conservation	& Revitalizati	on Proje	ct No: WP201		6-Oct-2013	to	19-Oct-2013
	[г г		1		
POINT	2	VM14-1#	VM14-2 #	VM14-3	VM14-4					
DATE	PD/(m)	mm/s	mm/s	mm/s	mm/s					
19-Nov-12 (0.103	0.112	0.147	0.136					
6-Oct-2013		0.100	0.112	0.117	0.120	Sunday				
7-Oct-2013		0.46	0.27	0.25	0.16					
8-Oct-2013		0.13	0.46	0.24	0.48					
9-Oct-2013		0.38	0.22	0.29	0.32					
10-Oct-2013		0.47	0.25	0.15	0.28					
11-Oct-2013		0.55	0.25	0.26	0.60					
12-Oct-2013		0.79	0.25	0.15	0.25					
13-Oct-2013						Sunday				
14-Oct-2013					Р	ublic Holiday				
15-Oct-2013		0.22	0.41	0.29	0.22					
16-Oct-2013		0.15	0.12	0.52	0.75					
17-Oct-2013		0.74	0.40	0.35	0.42					
18-Oct-2013		0.15	0.25	1.11	0.79					
19-Oct-2013		0.66	0.12	0.29	0.75					
Remarks										

14/14/	<u></u>		h→ +→ -→				(Block 14 Str	uctural A&A)
VVVV	亙誠建築	丄 桯有	 		Monitoring C	heck Pts.		Trigger Levels	
					_		Alert level	Alarm level	Action level
	Vay Constru	ction Comp	bany Ltu.		Vibration Monitoring			2.5mm/s	3mm/s
				# Vibration at lar	gest span of	5.0mm/s	6.0mm/s	7.5mm/s	
					highest Struct	ural level	0.01111/3	0.011111/5	1.011111/3
				Vibration	Record				
Project Title: Cen	tral Police Statio	n Conservation	& Revitalizati	on Proje	ct No: WP201		20-Oct-2013	to	2-Nov-2013
					T T				
POINT	VM14-1#	VM14-2 #	VM14-3	VM14-4					
DATE PD/(m) mm/s	mm/s	mm/s	mm/s					
19-Nov-12 (Initial)	0.103	0.112	0.147	0.136					
20-Oct-2013		-		-	Sunday				-
21-Oct-2013	0.25	0.25	0.52	0.85					
22-Oct-2013	0.27	0.45	0.13	0.26					
23-Oct-2013	0.46	0.79	0.25	0.57					
24-Oct-2013	0.51	0.14	0.16	0.17					
25-Oct-2013	0.15	0.25	0.48	0.54					
26-Oct-2013	0.48	0.75	0.98	0.27					
27-Oct-2013					Sunday				
28-Oct-2013	0.48	0.35	0.64	0.20					
29-Oct-2013	0.61	0.18	0.19	0.21					
30-Oct-2013	0.23	0.22	0.36	0.35					
31-Oct-2013	0.25	0.25	0.40	0.19					
1-Nov-2013	0.34	0.29	0.18	0.37					
2-Nov-2013	0.25	0.25	1.10	0.16					
Remarks									

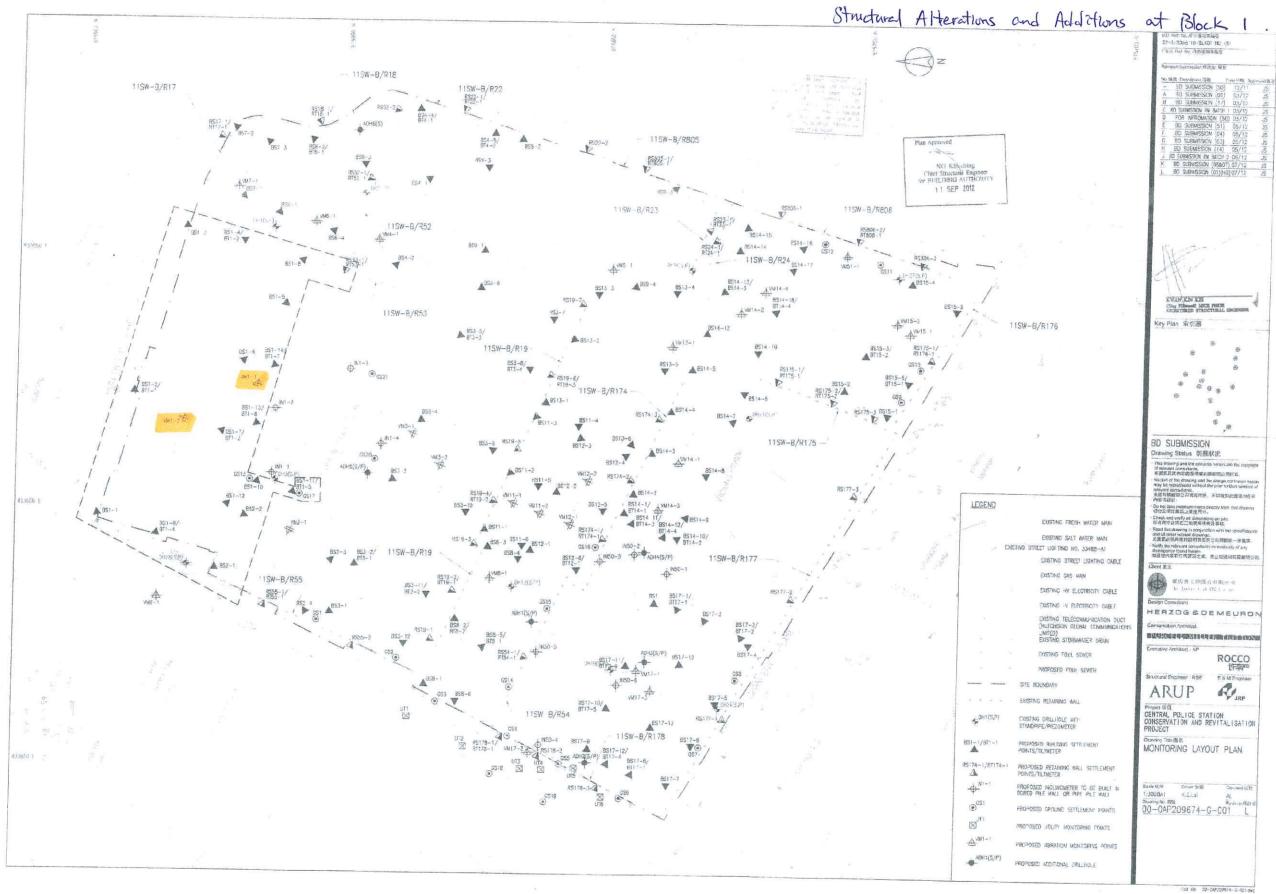

				Monitor	ring Check Pts.		Trigger Level	S
	ammo	an -				Alert level	Alarm level	Action level
					ion Monitoring	2mm/s	2.5mm/s	3mm/s
				# Vibratio	n at largest span of	5.0mm/s	6.0mm/s	7.5mm/s
				highest	Structural level	5.01111/3	0.01111/3	7.01111/3
			Vibratio	n Record				
roject Title: Cent	ral Police Sta	tion Conserva	tion & Revitalization	Project No:	WP202 (Block 1 A&	zA 25-Jul-2013	3 to	7-Aug-20
	1		1		1	1	1	
POINT	#VM1-1*	#VM1-2*						
DATE	mm/s	mm/s						
11-12-12 (Initial)	0.132	0.698						
25-Jul-13	0.370	0.354						
26-Jul-13	0.108	0.287						
27-Jul-13	0.552	0.170						
28-Jul-13				Sunday				
29-Jul-13	0.209	0.146						
30-Jul-13	0.111	0.384						
31-Jul-13	0.402	0.221						
01-Aug-13	0.436	0.326						
02-Aug-13	0.278	0.216						
03-Aug-13	0.117	0.151						
04-Aug-13				Sunday				
05-Aug-13	0.220	0.310						
06-Aug-13	0.109	0.250						
07-Aug-13	0.290	0.220						
							0	
Remarks: * same # Vibra		pan of highest st	ructural level		1.00	2	17 Aug 20	
			Prepared b	y : Wong Wing	Yee	Acknowledg		

	amm			Monitor	ing Check Pts.		Trigger Level	S
	amm	nn		Monitor	illig Check Fis.	Alert level	Alarm level	Action leve
				Vibration Monitoring		2mm/s	2.5mm/s	3mm/s
					n at largest span of	5.0mm/s	6.0mm/s	7.5 mm/s
				highest	Structural level			
			Vibration	Record				
oject Title: Cent	ral Police Sta	ation Conserva	tion & Revitalization	Project No:	WP202 (Block 1 A&	k/ 8-Aug-2013	to	21-Aug-20
POINT	#VM1 -1*	#VM1-2*						
DATE	mm/s	mm/s						
11-12-12 (Initial)	0.132	0.698						
08-Aug-13	0.145	0.167						
09-Aug-13	0.351	0.137						-
0-Aug-13	0.201	0.182						
1-Aug-13	-			Sunday		-		
12-Aug-13	0.126	0.106						
3-Aug-13	0.234	0.162						-
4-Aug-13	0.219	0.183						-
5-Aug-13	0.223	0.194						-
6-Aug-13	0.265	0.311						-
.7-Aug-13	0.168	0.136						
8-Aug-13	-			Sunday		-		
9-Aug-13	0.124	0.116						
20-Aug-13	0.554	0.106						
21-Aug-13	0.146	0.137						
Remarks: * same # Vibra		pan of highest stru		: Wong Wing	Vee	Acknowledge	ad by : Shu	i Wing

				Monitori	ng Check Pts.		Trigger Level	S
	amm	nn				Alert level	Alarm level	Action leve
					on Monitoring	2mm/s	2.5mm/s	3mm/s
					at largest span of Structural level	5.0 mm/s	6.0 mm/s	7.5 mm/s
			Vibration	Record				
roject Title: Cent	ral Police Sta	ation Conserv	vation & Revitalization	Project No: V	WP202 (Block 1 A&	&/ 22-Aug-2013	to	31-Aug-20
POINT	#VM1 -1*	#VM 1-2*						
DATE	mm/s	mm/s						
11-12-12 (Initial)	0.132	0.698						
22-Aug-13	0.158	0.109						
23-Aug-13	0.152	0.118						
24-Aug-13	0.213	0.185						
25-Aug-13	•		•	Sunday				
26-Aug-13	0.150	0.112						
27-Aug-13	0.156	0.256						
28-Aug-13	0.194	0.102						
29-Aug-13	0.153	0.143						
30-Aug-13	0.143	0.677						
31-Aug-13	0.129	0.161						
Remarks: * same # Vibra		pan of highest s		: Wong Wing	Vaa	Acknowledge	d by · Shu	i Wing



Manitarina <i>C</i> haola Dta]	S		
Monitoring Check Pts.	Alert level	Alarm level		
Vibration Monitoring	2mm/s	2.5mm/s	3mm/s	
# Vibration at largest span of	5.0mm/s	6.0mm/s	7.5mm/s	
highest Structural level				

POINT	#VM1-1*	#VM1-2*
DATE	mm/s	mm/s
11-12-12 (Initial)	0.132	0.698
01-Sep-13	Sun	-
02-Sep-13	0.166	0.170
03-Sep-13	0.580	0.303
04-Sep-13	0.138	0.167
05-Sep-13	0.159	0.104
06-Sep-13	0.160	0.102
07-Sep-13	0.095	0.169
08-Sep-13	Sun	day
09-Sep-13	0.139	0.178
10-Sep-13	0.548	0.137
11-Sep-13	0.207	0.087
12-Sep-13	0.335	0.841
13-Sep-13	0.090	0.121
14-Sep-13	0.323	0.446
15-Sep-13	Sun	day
16-Sep-13	0.137	0.112
17-Sep-13	0.120	1.190
18-Sep-13	0.382	0.102
19-Sep-13	0.131	0.108
20-Sep-13	Holi	day
21-Sep-13	0.422	0.583
22-Sep-13	Sun	day
23-Sep-13	0.478	0.639
24-Sep-13	0.147	0.164
25-Sep-13	0.165	0.143
26-Sep-13	0.128	0.870
27-Sep-13	0.172	0.189
28-Sep-13	0.384	0.230
29-Sep-13	Sun	day
30-Sep-13	0.302	0.158



Gammon Vibration Record of Block 1

POINT	VM1-1	VM1-2		
Date	mm/s	mm/s		
01-10-13			HOLIDAY	
02-10-13	0.207	0.362		
03-10-13	0.178	0.156		
04-10-13	0.122	0.212		
05-10-13	0.208	0.151		
06-10-13			SUNDAY	
07-10-13	0.143	0.200		
08-10-13	0.108	0.184		
09-10-13	0.160	0.239		
10-10-13	0.561	0.257		
11-10-13	0.093	0.194		
12-10-13	0.158	0.177		
13-10-13			SUNDAY	
14-10-13		-	HOLIDAY	
15-10-13	0.299	0.223		
16-10-13	0.102	0.223		
17-10-13	0.194	0.577		
18-10-13	0.160	0.153		
19-10-13	0.398	0.201		
20-10-13			SUNDAY	
21-10-13	0.445	0.280		
22-10-13	0.237	0.221		
23-10-13	0.272	0.216		
24-10-13	0.121	0.166		
25-10-13	0.122	0.256		
26-10-13	0.234	0.564		
27-10-13	 		SUNDAY	
28-10-13	0.580	0.122		
29-10-13	0.819	0.357		
30-10-13	0.207	0.415		
31-10-13	0.403	0.446		

Structural Additions and



1 z	lock しし B.D. Rel No 用字目的集成版
15700 M	22-3/3066/10/BLK11 (HU) (S) F.S.D. Ref No 法防废搜索编数
BIE	Revisian/Submission 性改成/极批
	No.编述 Description 說明 Date 日期 Approved畫
the second	- BD SUBMISSION (50) 12/11 JS A BD SUBMISSION (01) 03/12 JS
44	B BC SUBMISSION (17) 03/12 JS C BD SUBMISSION RW BATCH 1 03/12 JS
Shiu King	D FOP INFROMATION (50) 03/12 JS E BD SUBMISSION (51) 05/12 JS
Cont	F BD SUBMISSION (04) 05/12 JS
1	H BD SUBMISSION (14) 05/12 JS
8. A. C	J BD SUBMISSION RW BATCH 7 06/12 JS K BD SUBMISSION (06&07) 07/12 JS
	L BD SUBMISSION (01)(H0)07/12 JS M BD SUBMISSION (11) 07/12 JS
and the second s	
25 - 42 C	
S & S A MAN	
1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	
provide a serie a series a s	Plan Approved
	CHIONG Kam-yuene Jacky
2.	Chief Structural Engineer for BUILDING AUTHORITY
all	- 3 OCT 2012
Cert.	
B/R176	Key Plan 索引圖
C. L . C 3	• • •
Ę	0 0
iipa _c	• • • ///
	0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
1. 1	0 0
UR/	e l
EN .	
T	BD SUBMISSION
M. E.	Drawing Status 裂麗狀況 This drawing and the contents berein are the copyright
CEOR FISHINGE MICE PHILE C	of relevant consultants. 本確認及其內容的版標屬有關觀問公司所非。 - No part of the drawing and the design contained herein
A S	may be reproduced without the pror written consent of relevant consultants. 未維有時期間公司書面印度。不否依對此服紙內任何
	内容或设计 - Do not take measurements directly from this crawing.
EXISTING FRESH WATER MAIN	切勿直兆從醫紙上豐度尺寸。 Check and vorify all dimensions on site 研有尺寸必须在工地現場抱意及審核。
	 Read this drawing in conjunction with the specifications and all other related drawings, 此關係必須與規格投明實及其它有關團級一併問講。
STREET LIGHTING NC. 33488-A1	 Notify the relevant consultants immediately of any discrepancy found literein, 如發現內容有任何謬蹤之處。應立刻通知有質觀問公司。
EXISTING STREET LIGHTING CABLE	如發現內容有任何謬欲之處。應立刻通知有質範間公司。 Client 聚主
EXISTING GAS MAIN	· 赛馬台文物保存有限公司
EXISTING HV ELECTRICITY CABLE	The Jecker Club CP Limited
EXISTING LV ELECTRICITY CABLE	
EXISTING TELECOMMUNICATION DUCT	
LIMITED)	
	Executive Architect / AP
	ROCCO 计字严
	Structural Engineer / RSE E & M Engineer
	ARUP RIJRP
	Project 項目 CENTRAL POLICE STATION
KISTING DRILLHOLE WITH TANDPIPE/PIEZONETER	CONSERVATION AND REVITALISATION PROJECT
ROPOSED BUILDING SETTLEMENT	Drawing Tate 蜀名 MONITORING LAYOUT PLAN
DINTS/TILTMETER	MONTONING LATOUT PLAN
ROPOSED RETAINING WALL SETTLEMENT DINTS/TILTMETER	
DINTS/TILTWETER ROPOSED INCLINOMETER TO BE BUILT IN	Scale 분명 Drawn 변문 Checked 문편
oints/tiltmeter Roposed inclinometer to be Built in Ored Pile Wall or Pipe Pile Wall	1:3009AI K.C.Loi AL Drawing No.圆型 Revision修改版
OINTS/TILTMETER ROPOSED INCLINOMETER TO BE BUILT IN ORED PILE WALL OR PIPE PILE WALL ROPOSED GROUND SETTLEMENT POINTS	1:3009AI K.C.Lai AL
oints/tiltmeter Roposed inclinometer to be Built in Ored Pile Wall or Pipe Pile Wall	1:3009AI K.C.Loi AL Drawing No.圆型 Revision修改版
OINTS/TILTMETER ROPOSED INCLINOMETER TO BE BUILT IN ORED PILE WALL OR PIPE PILE WALL ROPOSED GROUND SETTLEMENT POINTS	1:3009AI K.C.Lai AL Drawing No.圆型 Revision增改图
	BURITAS EXISTING FRESH WATER MAIN EXISTING FOLL SEVER PROPOSED FOUL SEVER PROPOSED FOUL SEVER PROPOSED FOUL SEVER PROPOSED FOUL SEVER PROPOSED FOUL SEVER TE BOUNDARY KISTING CREIMING WALL KISTING DRULHOLE WITH

					Manit	- Classie Dta		Trigger Levels	
	iamm				Monitorir	ng Check Pts.	Alert level	Alarm level	Action level
					Vibration	n Monitoring	2mm/s	2.5mm/s	3mm/s
			Vibration at	largest span of	5.0 mm/s	6.0mm/s	7.5mm/s		
		highest Structural level				tructural level	5.01111/8	0.011111/8	7.511111/8
			7	Vibratior	n Record				
Project Title: Cen	tral Police Sta	ation Conserva	tion & Revi	Project N	lo: WP202 (B	Blk 11 A&A)	1-Aug-2013	to	14-Aug-2013
POINT	VM11-1*	VM11-2*							
DATE PD/(m)) mm/s	mm/s	mm/s	mm/s	mm/s				
23-Apr-2012 (Initial)	0.130	0.190							
01-Aug-13	0.58	0.23							
02-Aug-13	0.24	0.26							
03-Aug-13	0.51	0.16							
04-Aug-13					Sunday				
05-Aug-13	0.34	0.85							
06-Aug-13	0.50	1.43							
07-Aug-13	0.15	0.57							
08-Aug-13	0.40	0.39							
09-Aug-13	0.39	0.14							
10-Aug-13	0.35	0.32							
11-Aug-13					Sunday				
12-Aug-13	0.17	0.56							
	0.53	0.54							
13-Aug-13									

Remarks: * These points intercept with WP201 Block 50

Prepared by : Wong Wing Yee

Endorsed by : Shui Wing

Gammon

								Trigger Levels	
	amm	313			Monitorin	g Check Pts.	Alert level	Alarm level	Action level
	annn				Vibration	Vibration Monitoring		2.5mm/s	3mm/s
						largest span of uctural level	5.0 mm/s	6.0mm/s	7.5mm/s
				Vibration	Record				
Project Title: Centr	ral Police Sta	tion Conserv	ation & Revi	Project N	o: WP202 (B)	k 11 A&A)	15-Aug-2013	to	28-Aug-2013
POINT	POINT VM11-1* VM11-2*								
DATE PD/(m)	mm/s	mm/s	mm/s	mm/s	mm/s				
23-Apr-2012 (Initial)	0.130	0.190							
15-Aug-13	0.31	0.23							
16-Aug-13	0.35	0.40							
17-Aug-13	0.37	0.17							
18-Aug-13					Sunday				
19-Aug-13	1.86	0.14							
20-Aug-13	0.62	0.34							
21-Aug-13	0.51	0.31							
22-Aug-13	0.22	0.31							
23-Aug-13	0.18	0.21							
24-Aug-13	0.96	1.02							
25-Aug-13					Sunday				
26-Aug-13	0.41	0.56							
27-Aug-13	0.20	0.40							
28-Aug-13	0.35	0.20							

Remarks: * These points intercept with WP201 Block 50

Prepared by : Wong Wing Yee

Endorsed by : Shui Wing

1

	iammo				Monitorin	g Check Pts.		Trigger Levels	
	iamm	on					Alert level	Alarm level	Action level
					Vibration Monitoring		2mm/s	2.5mm/s	3mm/s
						largest span of	5.0mm/s	6.0mm/s	7.5mm/s
					highest St	ructural level	0.011111.5	0.011111.5	, io minis
				Vibration	Record				
	1.5.11					11 11 4 0 4			21 1 2012
Project Title: Cent	tral Police Sta	ation Conserv	ation & Revi	Project N	o: WP202 (B	lk II A&A)	29-Aug-2013	to	31-Aug-2013
POINT	VM11-1*	VM11-2*							
DATE PD/(m)) mm/s	mm/s	mm/s	mm/s	mm/s				
23-Apr-2012 (Initial)	0.130	0.190							
29-Aug-13	1.40	0.86							
30-Aug-13	0.31	0.30							
31-Aug-13	1.37	0.45							
					-				
						-			-
				~ ^ ^					

Remarks: * These points intercept with WP201 Block 50

.

Prepared by : Wong Wing Yee

Endorsed by : Shui Wing



Manitanina <i>C</i> haola Dta	Trigger Levels				
Monitoring Check Pts.	Alert level	ert level Alarm level Action level 2mm/s 2.5mm/s 3mm/s			
Vibration Monitoring	2mm/s	2.5mm/s	3mm/s		
# Vibration at largest span of highest Structural level	5.0 mm/s	6.0 mm/s	7.5mm/s		

PO	INT	VM11-1#*	VM11-2*	
DATE	PD/(m)	mm/s	mm/s	
	12 (Initial)	0.087	0.116	
02-Se	ep-13	0.184	0.400	
03-Se	ep-13	0.116	0.306	
04-Se	ep-13	0.128	0.192	
05-Se	ep-13	0.129	0.147	
06-Se	ep-13	0.153	0.122	
07-Se	ep-13	0.144	0.211	
08-Se	ep-13	SUNI	DAY	
09-Se	ep-13	0.157	0.172	
10-Se	ep-13	0.145	0.111	
11-Se	ep-13	0.128	0.274	
12-Se	ep-13	0.180	0.117	
13-Se	ep-13	0.230	0.091	
14-Se	ep-13	0.106	0.113	
15-Se	ep-13	SUNDAY		
16-Se	ep-13	0.306	0.156	
17-Se	ep-13	0.223	0.288	
18-Se	ep-13	0.311	0.117	
19-Se	ep-13	0.116	0.151	
20-Se	ep-13	HOLIDAY		
	ep-13	0.242	0.446	
22-Se	ep-13	SUNI	DAY	
23-Se	ep-13	0.087	0.087	
	ep-13	0.117	0.192	
25-Sep-13		0.117	0.086	
	ep-13	0.131	0.162	
	ep-13	0.131	0.216	
28-Sep-13		0.415	0.336	
	ep-13	SUNDAY		
	ep-13	0.302	0.158	



Gammon Vibration Record of Block 11

POINT	VM11-1	VM 11-2	
Date	mm/s	mm/s	
01-10-13			HOLIDAY
02-10-13	0.170	0.252	
03-10-13	0.232	0.264	
04-10-13	0.172	0.565	
05-10-13	0.186	0.116	
06-10-13			SUNDAY
07-10-13	0.087	0.093	
08-10-13	0.319	0.113	
09-10-13	0.120	0.097	
10-10-13	0.248	0.095	
11-10-13	0.169	0.132	
12-10-13	0.083	0.113	
13-10-13			SUNDAY
14-10-13		-	HOLIDAY
15-10-13	0.166	0.272	
16-10-13	0.098	0.217	
17-10-13	0.108	0.117	
18-10-13	0.103	0.209	
19-10-13	0.336	0.086	
20-10-13			SUNDAY
21-10-13	0.182	0.254	
22-10-13	0.587	0.145	
23-10-13	0.398	0.091	
24-10-13	0.160	0.122	
25-10-13	0.245	0.405	
26-10-13	0.091	0.129	
27-10-13		r	SUNDAY
28-10-13	0.117	0.323	
29-10-13	0.125	0.181	
30-10-13	0.120	0.137	
31-10-13	0.166	0.448	

Annex N

A Summary of Current Condition of Character Defining Elements

CENTRAL POLICE STATION, HONG KONG

SCHEDULE OF CHARACTER DEFINING ELEMENTS

This Schedule of Character Defining Elements has been prepared at the request of the Antiquities and Monuments Office (AMO) to support applications for S.6 approval under the Antiquities and Monuments Ordinance and the Environmental Impact assessment Ordinance. The levels of significance and their meanings are derived from the work of James Semple Kerr.

For each element, the level of significance is stated, together with the planned outcome and associated mitigation measure, where applicable, and the resultant impact upon the significance. Generally, only those items subject to change are noted, and the impacts should be read as negative. Where elements are deemed currently to be adverse, the impact of the changes should be read as positive.

The levels of significance and definitions as defined by Kerr are stated below. The criteria used to assess the significance of each element are, as directed by AMO : (i) the association with the operation of the Central Police Station Compound; and (ii) its architectural quality. Where these criteria conflict, the resultant assessment score is aggregated.

Each entry in the schedule is accompanied by a photograph of a sample of the item described. The location of each photograph is noted on the floor plans attached in the appendix to the schedule. Similar examples of each item can be seen by observation.

Central Police Station

	Level of significance	Meaning
	Exceptional	Where an individual space or element is assessed as displaying a strong contribution to the overall significance of the place. Spaces, elements or fabric exhibit a high degree of intactness and quality, though minor alterations or degradation may be evident.
	High	Where an individual space or element is assessed as making a substantial contribution to the overall significance of the place. Spaces, elements or fabric originally of substantial quality, yet may have undergone considerable alteration or adaption resulting in presentation which is either incomplete or ambiguous. The category also includes spaces, elements or fabric of average quality in terms of design and materials, but which exhibit a high degree of intactness.
Positive	Moderate	Where an individual space or element is assessed as making a moderate contribution to the overall significance of the place. Spaces, elements or fabric originally of some intrinsic quality, and may have undergone alteration or degradation. In addition, elements of relatively new construction, where the assessment of significance is difficult, may be included. This category also includes original spaces, elements or fabric of any quality which have undergone extensive alteration or adaption.
	Low	Where an individual space or element is assessed as making a minor contribution to the overall significance of the place, especially when compared to other features. Spaces, elements or fabric originally of little intrinsic quality, any may have undergone alteration or degradation. This category also includes original spaces, elements or fabric of any quality which have undergone extensive alteration or adaption to the extent that only isolated remnants survive (resulting in a low degree of intactness and quality of presentation).
	Neutral	Where an individual space or element is assessed as having an unimportant relationship with the overall significance of the place. Spaces, elements or fabric are assessed as having little or no significance.
	Adverse	Where an individual space or element detracts from the appreciation of cultural significance, by adversely affecting or obscuring other significant areas, elements or items.

Central Police Station

Addendum	Date
Item no. 10.029 edited entry	18 June 2013
Item no. 10.030 added	18 June 2013

Central Police Station

01 Police Headquarters

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.001	Flat plywood ceiling lining with plain rectangular cover battens		Adverse	Replace with T&G boarding to match existing	Not applicable	High
01.002	Plaster coving at abutments of walls and ceilings		Low	Remove in exceptional cases eg, where adjacent new lift shaft	Cut back neatly to a square edge and ensure remaining section is secure.	Low

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.003	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High
01.004	Timber thresholds at external doors and internal doors between main corridor and individual rooms		Low	Remove to enable level access	Splice extensions to door jambs, extend width of bottom rail of doors to match existing	Low

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.005	Plaster box cornice		Moderate	Remove in exceptional cases eg. where adjacent new lift shafts	Cut back neatly to a square edge and ensure remaining section is secure.	Moderate
01.006	Panelled doors		Moderate	Replace where necessary to achieve fire resistance to comply with Code	Re-use where possible. Record design on survey drawings where element cannot be re- used.	Moderate

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.007	External shutters		High	Reinstate to match existing pattern	Not applicable	High
01.008	External terraces at 1/F		High	Overlay existing concrete paving with timber deck to provide level access	New deck to be reversible	Low

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.009	Plaster ceilings on GF and LG1		Moderate	Install cloud ceilings to accommodate new services	Install fixed grid to minimise damage to ceiling	High
01.010	Timber door frames and architraves		Moderate	Conceal in exceptional cases eg. where adjacent new lift shaft	Retain architrave and door frame in situ. Avoid damage to joinery.	High

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.011	Concrete floor		Low	Replace where new kitchens and plant rooms to be installed	Carefully remove and retain existing floorboards for re-use. Ensure controlled demolition of concrete structure and removal of debris from building to avoid damage to adjacent surfaces. Protect or carefully remove and set aside adjacent elements such as skirting boards	Low

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.012	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	Not applicable	High

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.014	Existing door openings		Moderate	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Moderate
01.015	Existing walls		Moderate	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Moderate

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.016	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High
01.017	Mezzanine floor in room 01/LG1/13		Adverse	Remove floor and supporting columns to re-create original double-height space	Not applicable	High

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.018	Cast iron grilles above Service Corridor 01/LG1/35		High	Remove existing steel sheet covering [alterations to grilles awaiting confirmation from HdM]		
01.019	Perforated concrete deck above lightwell		Adverse	Remove deck and make good brickwork at abutments	Not applicable	High

November 2012 Draft 10
Purcell Miller Tritton LLP

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.020	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
01.021	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate

Central Police Station

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.022	Main corridors		High	Install new lighting, fire sprinklers, fire doors to comply with Fire Services Code	New fittings to be mounted in a manner that is of its time and reversible. Avoid physical intervention with existing plaster box cornices, architraves, dado rails	High
01.023	Painted signs	LOCKLEFT	High	Protect in situ	Not applicable	N/A

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.024	Fixed signs		Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.025	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material in a neutral mid-tone.	High

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.026	Enclosure at First Floor landing of main stair		Adverse	Remove	Not applicable	Moderate

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.027	Steel railing enclosure at FF level		Low	Remove	Record on measured drawings and photographs	Low
01.028	Tongued and grooved flat and sloped timber boarded ceilings		Moderate	Repair where necessary and reinstate where missing	Not applicable	Moderate

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.029	Modern partitions		Adverse	Remove	Not applicable	High
01.030	Tiled dado		High	Cut away for enlargement of existing windows to form new doorways	Cut back to joint line and adjust tiling pattern to suit new opening. New tiles to match existing sizes and colours.	Moderate

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.031	Reinforced concrete canopy and sash windows		Moderate	Remove canopy and replace sash windows with new windows to match original	Make good brickwork where canopy removed, Reinstate rendered architraves around new window to match similar window facing on West wing	Moderate

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.032	Arched opening in brick wall above ceiling line		Low	Retain insitu and use to pass through future services. Infill only where opening is within a fire compartment	Use non-combustible material to block opening.	Low

Element no.	Description	Photo ref	Significance	Proposal	Mitigation	Impact
01.033	Ceiling void service installation (Cast Iron Water Tank and pipework)		Low	Remove and make good adjacent surfaces	N/A	Low

Central Police Station

02 Armoury

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.001	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High
02.002	Modern internal doors		Adverse	Remove	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.003	Modern partitions		Adverse	Remove	Not applicable	High
02.004	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.005	Brickwork walls enclosing rooms at GF and FF East side		Low	Remove and reinstate verandah	Not applicable	High
02.006	Concrete floors		Low	Selected removal to accommodate new stairs and lift shaft	Carefully form openings to ensure structural stability	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.007	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	No applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.008	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.009	Concrete stairs		Adverse	Remove stairs	Not applicable	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
02.010	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts to reduce impact. Finish ducts in a non- reflective material that is neutral in colour and mid-tone.	High
02.011	Roof structure and tiled soffit		High	Repair and retain.	N/A	Neutral

03 Barracks Block

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.001	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
3.002	Panelled doors		Moderate	Replace where necessary to achieve fire resistance to comply with Code	Re-use where possible. Record design on survey drawings where item cannot be re-used.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.003	External shutters		High	Reinstate to match existing pattern	Not applicable	High
03.004	Timber thresholds at external doors and internal doors between main corridor and individual rooms		Low	Remove to enable level access	Splice extensions to door jambs, extend width of bottom rail of doors to match existing	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.005	Timber spandrel panels below windows		Low	Conceal in exceptional cases eg. where adjacent new lift shaft	Retain frame and spandrel panel where possible. Remove only where necessary in connection with re- planning of interiors. Record on measured survey drawings.	Low
03.006	Timber floors		High	Replace where new kitchens and plant rooms to be installed	Limit extent of removal as much as possible. Carefully remove and retain existing floorboards for re-use. Ensure controlled dismantling of timber structure and set aside for possible re-use. Protect or carefully remove and set aside adjacent elements such as skirting boards	Medium

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.007	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	No applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.008	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High
03.009	Block existing door openings		Low	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.010	Form new door openings		Low	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance. Re-open original openings where possible. Retain original reveals and arches.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.011	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.012	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
03.013	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.014	Painted signs	NO VISITOR WILL BE ADMITTED WITHOUT THE PERMISSION OF THE D.O. OR FORMATION COMMANDER 或官管主得未如者訪探 進撞得不可許官警值當	High	Protect in situ	Not applicable	N/A
03.015	Fixed signs	NO. 3 PLATOON R. & F CHANGING ROOM 第三隊更衣室	Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.016	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour and mid-tone.	High
03.017	Lean-to structure adjacent North wall		Moderate	Remove	Record on measured survey drawings. Make good walls where roof structure abuts	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.018	Metal-frames windows at GF North elevation		Adverse	Remove window frames, masonry spandrel panels below and reinstate verandah	Not applicable	High
03.019	Internal walls at Ground Floor level		Moderate	Remove selected internal walls where strictly necessary as part of re- planning of interiors	Walls of early or original date to be retained in part eg. by leaving a "nib" where the wall is bonded to another wall. At the point where the wall is cut away, form the cut-line on the line of a vertical joint in alternate courses. Bricks in the remaining courses to be left "as cut", and not re- bonded. Record walls on measured survey dwgs.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.020	Assembly rooms at centre of building (all floors)		Moderate	Sub-divide two rooms on each floor to provide service core, comprising: lifts, toilets, plant rooms, stores	Form new sub-visions using lightweight partitions to achieve reversibility. Form straight joints at abutments with existing retained walls. Notch new partitions around existing brick corbels at high level as a reminder of current condition.	Moderate
03.021	Exposed soffits of timber floors		Moderate	Underline existing floors to achieve specified fire resistance stated in Code	Avoid unnecessary damage to existing structure. New lining will reduce extent of intervention into existing structure. Keep level of new linings well clear of window heads.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.022	Existing window frames/openings		High	Open up selected openings to form new fire escape doors	Retain any salvageable material for possible re- use elsewhere. Retain existing window jambs intact. Cut away masonry to form door openings along same line as window jamb; do not re-bind cut brickwork. Record existing condition on measured survey drawings.	Low
03.023	Single storey outbuildings on south side		Adverse	Demolish	Check for evidence of early route from Magistracy to Prison.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.024	Bridge at east end		Moderate	Retain	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.025	Chimneypiece on Ground Floor		Low	Repair and retain in current location	Not applicable	Neutral
03.026	Window in south wall; original dormitory space		Moderate	Remove window and take down brickwork spandrel; subdivide space to form new fire- protected escape route.	Record existing condition on measured survey drawings. New partition wall to be reversible.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
03.027	Clay-tiled floor in store room adjacent stairs		Low	Remove as part of re- planning of interiors	Record on measured survey drawings	Low

Central Police Station

04 Dormitory Block A & B

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.001	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High
04.002	Timber thresholds at external doors and internal doors between main corridor and individual rooms		Low	Remove to enable level access	Splice extensions to door jambs, extend width of bottom rail of doors to match existing	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.003	Plaster box cornice		Moderate	Remove in exceptional cases where eg. where adjacent new lift shafts	Cut back neatly to a square edge and ensure remaining section is secure.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.004	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	No applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.005	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.006	Block existing door openings		Moderate	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.007	Form new door openings		Moderate	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.008	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.009	Window frames in arcades of North and East elevations		Adverse	Remove window frames and make good masonry reveals and reinstate verandah	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.010	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.011	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.012	Stair from First to Second Floor		High	Replace stair to improve safety	New stair to be built of steel to comply with Code and to distinguish it as being "of its time".	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.013	External verandahs		High	Install new lighting, fire sprinklers, fire doors to comply with Fire Services Code, extract ducting to external walls	New fittings to be mounted in a manner that is of its time and reversible. Avoid physical intervention with existing plaster box cornices in rooms, architraves, dado rails. Position outlet grilles in extneral walls on centre- line of arcade arches and above structural arch	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.014	Painted signs	BLOCK A	High	Protect in situ	Not applicable	N/A
04.015	Fixed signs		Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.016	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour.	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.017	Toilets at ends of verandahs		Adverse	Remove and make good finishes	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.018	Partitions at GF Dormitory A		High	Remove to make way for Interpretation	Prepare measured drawings and photographs before removal.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.019	Switchgear in old porch 04/G/13		Adverse	Open up porch, remove electrical switchgear and make good	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.020	Flat plywood ceiling lining with plain rectangular cover battens		Adverse	Replace with T&G boarding to match existing	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.021	Steps up to doorway on FF verandah		Moderate	Remove steps and doorway to form new fore escape route	Record steps and doorway on measured drawings	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.022	Timber boarded floors with moulded skirtings		High	Retain all boarded floors and skirtings	Reinstate floor boards and skirtings after fire proofing works	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.023	Cantilever balconies		High	Retain and repair as necessary. Reinstate balcony on west elevation.	Avoid highly visible intervention to enhance structural integrity and/or compliance with building codes. Restrict access if necessary to achieve this objective.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.024	Clay tile floor		Low	Retain and repair as necessary	Not applicable	Neutral
04.025	Matched- boarded ceiling with perforated border		Moderate	Repair and retain insitu	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
04.026	Ceiling rose		Low	Repair and retain insitu	Not applicable	Neutral

Central Police Station

06 Dormitory C

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.001	Granite thresholds at external doors		Low	Retain; install timber deck flush with level of step where necessary	Avoid alteration to step.	Low
06.002	Pitched roof		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour and mid-tone.	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.003	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	Not applicable	High
06.004	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.005	Altered doors and windows		Adverse	Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable
06.006	External airconditioning units and other external services		Adverse	Adverse	Remove and make good brickwork	Not applicable

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.007	Painted signs	CECCEC	High	Protect in situ	Not applicable	N/A
06.008	Fixed signs	有生著 DEPARTMENT OF HEALTH 中央 警署 診療所 POLICE MEDICAL POST CENTRAL POLICE STATIN	Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.009	Cantilever balconies		High	Retain and repair as necessary.	Avoid highly visible intervention to enhance structural integrity and/or compliance with building codes. Restrict access if necessary to achieve this objective.	Low
06.010	Iron balustrades		High	Retain and repair as necessary.	Avoid highly visible intervention to enhance structural integrity and/or compliance with building codes. Restrict access if necessary to achieve this objective.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.011	Perforated margin at perimeter of ceiling		Low	Repair and retain.	Where fire-proofing of floor is required, use a product that can be installed within the floor void, leaving the ceiling lining intact.	Low
06.012	Block existing door openings		Moderate	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.013	Form new door openings		Moderate	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Moderate
06.014	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.015	Timber floors		High	Retain all boarded floors and skirtings	Reinstate floor boards and skirtings after fire proofing works	Low
06.016	Vinyl tile floor		Adverse	Remove tiles; renew boarded floor boards if necessary	Not applicable	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
06.017	Batten and panel ceiling lining		Low	Replace with lath and plaster ceiling	Not applicable	Low
06.018	Exposed roof covering		Moderate	Retain as existing	Consider insulating between upper and lower layers of roof tiles to provide thermal insulation and vapour barrier	Low

07 Dormitory D

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.001	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour and mid-tone.	High
07.002	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	No applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.003	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High
07.004	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.005	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
07.006	Clothes drying racks		Adverse	Remove	Not applicable	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.008	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High
07.009	Corbelled brickwork at perimeter of room		Low	Remove in exceptional cases where eg. where adjacent new lift shafts	Cut back neatly to a square edge and ensure remaining section is secure.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.010	Plywood floor		Adverse	Replace with hardwood floor boards	Not applicable	High
07.011	Timber thresholds at external doors and internal doors between main corridor and individual rooms		Low	Remove to enable level access	Splice extensions to door jambs, extend width of bottom rail of doors to match existing	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.012	Form new door openings		Moderate	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Moderate
07.013	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.014	Fixed signs	中央子子会子会子 Control 1: tree Stanue Acellent Por 二日 社会社 月 王 日本 日本 日 王 日本 日本 日 日 日本 日本 日 日 日 日 日 日 日 日 日 日 日 日	Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
07.015	Exposed roof tiling		Moderate	Retain as existing	Consider insulating between upper and lower layers of roof tiles to provide thermal insulation and vapour barrier	Low
07.016	Concrete floor		Adverse	Overlay with hardwood floor boards	Not applicable	Moderate

Central Police Station

08 Ablutions Block

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.001	Panelled doors		Low	Replace where necessary to achieve compliance with Building Code	Re-use where possible. Record design on survey drawings where element cannot be re-used.	Moderate
08.002	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	No applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.003	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High
08.004	Block existing door openings		Moderate	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.005	Timber roof structure		High	Retain	Not applicable	Neutral
08.006	External stair at west end		Moderate	Retain	Repair as necessary. Alter balustrade to achieve reasonable level of operational safety. Restrict access to repairs and maintenance and means of escape.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.007	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
08.008	Painted signs	NO VISITOR WILL BE ADMITTED WITHOUT THE PERMISSION OF THE D.O. OR FORMARIO/FORMANDER 支官查達羅本如者分辨 道證得來可非當查頂書	High	Protect in situ	Not applicable	N/A

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.009	Wire mesh screens		Adverse	Remove	Not applicable	Low
08.010	Internal walls and concrete floors		Low	Remove and rebuild in new configuration to suit new use	Ensure retained facades are fully supported during construction operations. Protect retained walls against damage during demolition works. Install new walls and floors to respect fenestration; avoid	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
					clashes.	
08.011	Cantilever balconies on north side		Moderate	Repair and retain insitu	Not applicable	

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.012	Bridge access to Barrack Block		Moderate	Retain	Repair as necessary. Alter balustrade to achieve reasonable level of operational safety. Restrict access to repairs and maintenance and means of escape.	Low
08.013	Balcony balustrades		Low	Repair as necessary and retain. Remove selected sections to enable installation of new bridge connections to Barrack Block.	Avoid removal of associated iron columns. Form interventions at selected positions so as to maintain the rhythm of the balustrades and ensure proper support at ends.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
08.014	Single-storey outbuilding with pitched roof over		Low	Demolish to make way for new loading bay.	Record on measured survey drawings. Infill existing internal opening leaving reveals exposed. Tooth-in new brickwork at abutments after existing walls removed. Salvage cast iron columns for possible re-use.	Low
08.015	Corrugated steel sheet on balcony balustrades		Adverse	Remove	Not applicable	Low

Central Police Station

Central Police Station

09 Magistracy

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.001	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High
09.002	Modern partitions		Adverse	Remove	Not applicable	N/A

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.003	Internal walls		Moderate	Remove selected internal walls where strictly necessary as part of re- planning of interiors	Walls or early or original date to be retained in part eg. By leaving a "nib" where the wall is bonded to another wall. At the point where the wall is cut away, form the cut-line on the line of a vertical joint in alternate courses. Bricks in the remaining courses to be left "as cut", and not re- bonded, as evidence of the current condition.	Moderate
09.004	Plaster box cornice		Moderate	Remove in exceptional cases eg. Where adjacent new lift shafts	Cut back neatly to a square edge and ensure remaining section is secure.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.005	Panelled doors		Moderate	Replace where necessary to achieve fire resistance to comply with Code	Re-use where possible. Record design on survey drawings where element cannot be re-used.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.006	Block existing door openings		Moderate	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Moderate
09.007	Form new door openings		Moderate	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.008	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate
09.009	Fixed signs		Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.010	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
09.011	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour and mid-tone.	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.012	Rainwater goods		Moderate	Replace with larger sizes/closer spacing to improve performance	Use cast iron to match original pattern Make good all redundant fixing holes	High
09.013	Metal walkways across lightwell		Adverse	Remove walkways and make good brickwork at abutments	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.014	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High
09.015	Sloping canopy over external stair on west side		Adverse	Remove canopy and supporting structure	Not applicable	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.016	Single storey secure shelter at North West corner		Low	Demolish	Make good brickwork at abutments.	Low
09.017	Iron railing adjacent south side of item 09.016 above		Moderate	Retain; including remains of bars (now removed) between existing railings and east side of Barracks Block.	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.018	Public toilets in 09/LG1/17, 24		Adverse	Strip out sanitaryware, and fit-out for pottery display/service access. Form new door openings in east walls.	Retain existing door openings and metal- barred gates. Retain external granite steps and existing ground level.	Low
09.019	Cell doors		High	Re-open to provide access to Retail space	Retain existing iron gate	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.020	Meeting room at G/02-05		Moderate	Remove timber panelling from walls and sub divide to form new toilets and lift shaft	Record existing wall linings, and any earlier lining behind, on measured survey drawings.	Moderate
09.021	Lobbies within entrance hall G/12		Adverse	Remove	Not applicable	N/A

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.022	Public galleries on FF		Adverse	Strip out plant, remove partition walls and restore galleries	Not applicable	High
09.023	Chimney piece		Moderate	Retain	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.024	Lanterns above entrance hall		Adverse	Remove existing lanterns and install single lantern	Not applicable	Moderate
09.025	Boarded ceilings on Second Floor		High	Repair and retain where possible	Limit extent of penetrations as far as practicable. Record on measured survey drawings where ceilings have exceptionally to be removed.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
09.026	Iron gates at top of external stair		Moderate	Retain	No applicable	Neutral
09.027	Iron balustrade adjacent terrace at First Floor east side		High	Retain; install structural glass balustrade inboard of ironwork to provide compliance with Building Codes	Avoid penetration of existing tiled pavement when fixing glass balustrade.	Low

Central Police Station

10 Assistant Superintendent's Office

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.001	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High
10.002	Plaster box cornice		Moderate	Remove in exceptional cases eg. Where adjacent new lift shafts	Cut back neatly to a square edge and ensure remaining section is secure.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.003	Panelled doors and linings		Moderate	Replace where necessary to achieve fire resistance to comply with Code	Re-use where possible. Record design on survey drawings where element cannot be re-used.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.004	Timber boarded floor with moulded skirtings		High	Repair as necessary and retain	Lift carefully and refix upon completion of fire- proofing and services installation	Low
10.005	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.006	Block existing door openings		Moderate	Block opening as part of re-planning of interior	Retain existing door frame and architraves. Use framing and non- combustible sheet linings to block opening.	Moderate
10.007	Form new door openings		Moderate	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.008	Altered doors and windows		Adverse	Repair or renew as necessary existing frames to match original patterns	Not applicable	High
10.009	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.010	Stair balustrades		High	Balustrades to be supplemented with additional handrails and supports to mitigate non- compliance with code	New fittings to be of their time and made reversible. Physical intervention to existing stairs and balustrades to be kept to the minimum.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.011	Fixed signs		Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A
10.012	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour and mid-tone.	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.013	Internal walls		Moderate	Remove selected internal walls where strictly necessary as part of re- planning of interiors	Walls or early or original date to be retained in part eg. By leaving a "nib" where the wall is bonded to another wall. At the point where the wall is cut away, form the cut-line on the line of a vertical joint in alternate courses. Bricks in the remaining courses to be left "as cut", and not re- bonded, as evidence of the current condition.	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.014	Partitions on SF		Moderate	Remove partitions	Record partitions on measured drawings	Moderate
10.015	Blocked windows on south elevation of south-east wing		Adverse	Re-open window openings and reinstate window frames and glazing	Not applicable	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.016	Open-joisted ceiling on Ground Floor of south- east wing		Moderate	Underline floor to provide fire protection.	Avoid intrusive alteration. Use fire-proofing products and methods that enable existing structure and boarding to be retained.	Low
10.017	Moulded timber picture rail		Low	Repair and retain	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.018	Timber roof structure above south-east wing		Moderate	Repair as necessary and retain	Avoid intrusive alteration. Retain open appearance/	Low
10.019	Timber stair		Moderate	Underline with fire- resisting lining	Repair as necessary and retain.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.020	Clay/terrazzo tile floor on Ground Floor and steps		Adverse	Adjust levels to enable level access and replace floor finish	Not applicable	Low
10.024	Granite wall on North elevation		High	Construct new external steps adjacent wall	Keep new stair clear of wall; avoid any physical connection between steps and wall.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.025	Single storey outbuilding at South East corner		Moderate	Demolish outbuilding and make good at abutments	Record outbuilding on measured drawings	Low
10.026	Blocked archway on East elevation		Adverse	Demolish infilling and re- open archway	Protect original arch and jambs against damage during demolition	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.027	Chimney on east elevation		Low	Retain	Not applicable	Neutral
10.028	Cantilever balconies		High	Repair as necessary and retain	Avoid intrusive interventions. Restrict access if necessary to retain existing appearance.	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
10.029	Steps on east elevation		Moderate	Repair as necessary and retain	Not applicable	Neutral
10.030	Decorative metal screen (See also item 10.026)		Low	Repair and retain	Not applicable	Positive

Central Police Station

11 A Hall

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.001	Form new door openings		Low	Form new opening as part of re-planning of interiors	New doors and frames to be of their time to avoid confusion about provenance	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.002	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
11.003	Painted signs		High	Protect in situ	Not applicable	N/A

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.004	Fixed signs	警告 小心地滑 CAUTION SLIPPERY FLOOR	Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A
11.005	Concrete stairs		Low	Remove and rebuild as part of re-planning of interiors	None	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.006	Flat roof		Low	Form new rooftop extension at West end to accommodate fire escape stair	Form straight joint at abutment with building 08 Ablutions Block	Low
11.007	Security screen at roof level		Low	Remove	Record on measured survey drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.008	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.009	Rainwater goods		Low	Remove embedded cast iron pipework set into wall to reduce long term maintenance burden	Record on measured survey drawings. Make good cavity.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.010	Timber doors		Low	Repair and retain	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.011	Security screen and door at First Floor		Low	Remove	Record on measured survey drawings	Low
11.012	Door thresholds and plinth		Low	Retain; remove paint media from plinth and brickwork	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
11.013	Metal louvres on window openings		Adverse	Remove	Not applicable	Low

Central Police Station

12 B Hall

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
12.001	Flat roof		Moderate	Repair and retain	Avoid roof penetrations as far as possible	Low
12.002	Cells at GF level		High	Remove cells in selected locations to accommodate new North-South route across site	Record existing layout on measured survey drawings. Limit number of cells affected to the minimum necessary. Retain floor structure above. Retain remainder of cells at this level for interpretation	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
12.003	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
12.004	Painted signs		High	Protect in situ	Not applicable	N/A

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
12.005	Fixed signs		Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A
12.006	Rainwater goods		Adverse	Replace with cast iron in pattern to match original and in correct locations	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
12.007	Corbelled brickwork at high level in cells		Low	Retain	Not applicable	Neutral
12.008	Barbed wire		Moderate	Remove	Record wire on measured drawings	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
12.009	External walls		Moderate	Form openings in North and South walls in conjunction with new North-South route across site	Cut brickwork to form openings in North and South walls; do not re-bond brickwork.	Moderate

Central Police Station

13 C Hall

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.001	External airconditioning units and other external services		Adverse	Remove	Not applicable	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.002	Door to Ladder Store		Low	Retain	Not applicable	Neutral
13.003	Security bars at window openings		Low	Retain	Not applicable	Neutral

June 2013 Draft 11
Purcell Miller Tritton LLP

142

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.004	Flat roof		Low	Retain	Avoid roof penetrations as far as possible.	Low
13.005	Eaves detail		Low	Retain	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.006	Cantilever reinforced concrete canopy		Low	Retain	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.007	Internal partition walls		Low	Remove as part of re- planning of interiors	Record on measured survey drawings	Low
13.008	Fixed signs		Low-High	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	N/A

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.009	Metal window frames		Moderate	Repair and retain	Not applicable	Neutral
13.010	Internal security screens		Moderate	Retain where possible	Where necessary record on measured survey drawings prior to removal	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.011	Coving at abutments between RC beams and walls		Low	Avoid penetrations for services installations as far as possible.	Cut away neatly for services penetrations and make good at abutments.	Low
13.012	Communal cells at Ground Floor		Moderate	Remove as part of re- planning of interiors	Record on measured survey drawings	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.013	Rooflight and security bars over communal cells		Moderate	Remove as part of re- planning of interiors	Record on measured survey drawings	Low
13.014	Granite threshold at external door openings		Low	Retain	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
13.015	Timber boarded doors with fanlight over		Low	Repair as necessary and retain	Not applicable	Neutral
13.015	Vinyl tile floor		Adverse	Replace	Not applicable	Low

June 2013 Draft 11
Purcell Miller Tritton LLP

149

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact

Central Police Station

14 D Hall East Wing

Element no. Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.001 West ent Lower Gr Floor		Moderate	Retain as public entrance at this level.	Retain security gate and granite threshold. Adjust adjacent ground level as necessary to achieve barrier-free access. Pin gate back against adjacent wall in the open position if necessary.	Low

Central Police Station

Element no. Description		Photo ref.	Significance	Proposal	Mitigation	Impact
head	-round ded doorway side lights		Moderate	Retain	Remove air duct and make good masonry above arch.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.003	Granite surround to cells (generally north side, alternating with brick surrounds – see next item)		Moderate	Retain door surround and gate wherever possible.	Pin back gate against wall. Remove paint media to expose granite material.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.004	Brick reveals with bull-nosed arrisses and segmental arch over (generally north side, alternating with granite surrounds – see previous item)		High	Retain door surround and gate wherever possible	Pin back gate against wall	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.005	Arched opening at East end First Floor		Low	Retain as existing	Not applicable	Low
14.006	Concrete floor generally at Lower Ground Floor		Low	Excavate entire floor to install piled underpinning	Record levels on measured survey drawings. Install new floor at the same level.	Low

June 2013 Draft 11
Purcell Miller Tritton LLP

155

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.007	Part-blocked windows at Lower Ground Floor - extent of blocking varies.		Moderate	Open up window opening to full extent.	Record existing condition on measured survey drawings. Add further detail during demolition works.	Low
14.008	External granite stair from Lower Ground to Ground Floor level		Moderate	Remove stair to make way for new stair in similar position	Review design proposals to see whether existing stair can be retained.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.009	Ashlar pattern on external walls		Moderate	Form new openings for entrance/exit to building	Set out new openings to cause minimum disruption to ashlar pattern. Record existing pattern on measured survey drawings.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.010	Blocked doorway at south-east corner		Low	Preserve blocked opening intact.	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.011	Metal security gate and screen		Low	Retain insitu	Pin gate in open position if necessary	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.012	Half-round headed doorway and side lights at Ground Floor west end		Moderate	Retain insitu	Not applicable	Neutral
14.013	Structural steelwork bracing and temporary access stair		Adverse	Remove upon completion of underpinning	Not applicable	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.014	RC staircase at north-east corner		Low	Remove	Record on measured drawings	Low
14.015	Vinyl tile floor on suspended timber floor		Adverse	Remove vinyl tiles and restore boards if possible; alternatively, replace boards with new timber to match other boarded floors elsewhere on the site.	Not applicable	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.016	Cell walls at Ground Floor		Moderate	Retain insitu	Use existing door openings wherever possible. Avoid further alteration to existing altered openings where feasible.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.017	Mortuary		High	Preserve insitu	Avoid any service penetrations from adjacent spaces	Neutral
14.018	Brickwork surrounds to doorways with segmental arches over		Moderate	Increase width in selected locations to allow wheelchairs to pass	Record on measured survey drawings. Limit interventions as far as possible.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.019	Granite surrounds to doorways with lintels over		Moderate	Increase width in selected locations to allow wheelchairs to pass	Record on measured survey drawings. Limit interventions as far as possible.	Low
14.020	Flat ceilings at Ground Floor		Low	Form penetrations for services installations where necessary	Avoid disruption of beams.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.021	Arched opening at east end		Low	Retain insitu	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.022	Top-lit central hall		High	Retain insitu	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.023	Arches across central hall at First Floor		Moderate	Retain insitu	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.024	Inset security gate and screen in First Floor cells		Low	Remove to suit new use	Remove where necessary. Record on measured drawings.	Low

Central Police Station

14 D Hall West Wing

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.030	Main stair		High	Remove wire mesh and framing	Record on measured drawings	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.031	Brick vault over central hall at Ground Floor		High	Retain insitu	Not applicable	Neutral
14.032	Terrazzo floor in central hall at Ground floor		Moderate	Remove to enable piled underpinning	Record on measured survey drawings	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.033	Brick vaults above cells		High	Retain insitu	Avoid penetrations for services	Neutral
14.034	Cell walls (later additions)		Moderate	Remove where necessary to accommodate new cafe	Record on measured drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.035	Brickwork spandrels below cell windows on south side at Ground Floor		Moderate	Remove to accommodate new cafe	Record on measured survey drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.036	Cell walls flanking central hall		High	Remove to accommodate new cafe	Record on measured survey drawings. Retain selected cells for interpretation purposes.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.037	Cell floors		Low	Remove to enable piled underpinning	Record on measured survey drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.038	Partition wall across central hall at Ground Floor		Low	Remove to accommodate new cafe	Record on measured survey drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.039	Granite pavement in cross-passage between East and West Wings		Moderate	Repair as necessary and retain insitu	Not applicable	Neutral
14.040	Granite threshold at doorway between cross- passage and East Wing		Moderate	Retain insitu	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.041	Brick vault over cross-passage		High	Retain insitu	Avoid any services penetrations	Neutral
14.042	Granite floor in central hall at First Floor		Moderate	Retain insitu	Repair where necessary	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.043	Cell walls flanking central hall at First Floor		High	Retain insitu	Not applicable	Neutral
14.044	Brickwork spandrels below cell windows at Second Floor		Moderate	Remove to enable new use	Record on measured drawings. Confine changes to one elevation, north or south.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.045	Metal security screen adjacent main stair		Moderate	Retain insitu	Not applicable	Neutral

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.046	Double-height central hall at Second Floor		High	Retain insitu	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.047	View ports adjacent entrance doors		Moderate	Retain insitu	Not applicable	Neutral
14.048	Services installations		Adverse	Remove	Not applicable	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.049	Metalwork and structural steel framing on exterior (typical)		Adverse	Remove	Not applicable	High
14.050	Blind arcade, south elevation		Low	Remove infill brickwork within arched openings at ground level to enable new cafe	Record on measured survey drawings. Observe and record any evidence that brickwork infills were built at the same time as the arched openings or added later	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
14.051	Blind arcade, north elevation		Low	Retain insitu	Not applicable	Neutral
14.052	Fence wall, east end of D Hall Yard		Low	Remove to reinstate access to granite stair to Lower Ground Floor level	Record on measured drawings	Low

Central Police Station

15 E Hall

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.001	Dividing walls at Lower Ground Floor		Moderate	Remove to enable multi- purpose use	Record on measured survey drawings	Low
15.002	Dividing walls at Lower Ground Floor		Moderate	Remove to enable multi- purpose use	Record on measured survey drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.003	Staircase within Laundry Yard		Moderate	Remove to enable construction of Arbuthnot Wing	Record on measured survey drawings	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.004	Services installations		Adverse	Remove	Not applicable	Moderate
15.005	Metal louvres over cell window openings		Low	Remove	Record on measured survey drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.006	Raised ground level adjacent entrance		Low	Remove to enable level access	Record on measured survey drawings	Low
15.007	Access balconies and apertures		Moderate	Retain apertures	Provide temporary closure as required for operational reasons	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.008	Central staircase		High	Retain	Provide secondary staircase within cell blocks to achieve code compliance	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.009	Cell walls flanking central hall		High	Retain	Pin back cell doors against walls.	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.010	Services installations		Adverse	Remove	Not applicable	Moderate
15.011	Balcony balustrades		Moderate	Retain	Install wire net across aperture to avoid need to upgrade balustrade to meet Building Code requirements	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
15.012	Second Floor central hall		High	Retain	Not applicable	Neutral

Central Police Station

17 F Hall

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.001	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.002	Rainwater goods		Low	Remove existing RWPs and install new RWPs externally on North and South Elevations	Improve roof drainage to avoid ponding	Low
17.003	Exterior decorations		Adverse	Strip off and redecorate	Sample and analyse existing paint media; select new media to suit substrate and significance	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.004	External airconditioning units and other external services		Adverse	Remove and make good brickwork	Not applicable	High
17.005	Fixed signs	PRISONERS' PRIVATE CLOTHING STORE 犯人私家衣服儲藏室	Moderate	Remove and refix/display in visitors' centre/discard	Record each sign and assess significance individually and treat accordingly	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.006	Security screen at First Floor entrance		Low	Remove	Record on measured drawings	Low
17.007	Metal windows		Moderate	Remove at First Floor to accommodate gallery space and block structural openings with blockwork	Record on measured drawings.	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.008	Fixed furniture		Moderate	Remove to accommodate gallery space	None	Low
17.009	Security screens		Moderate	Remove to accommodate gallery space	Record on measured drawings	Moderate

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.010	Timber windows		Moderate	Remove at First Floor to accommodate gallery space and block structural openings with blockwork	Record on measured drawings	Moderate
17.011	Communal washing/lavatory facilities		Moderate	Remove to accommodate gallery space	Record on measured drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.012	Blocked up lantern light		Low	Unblock lantern and fit glazing	Record on measured drawings	Low
17.013	Security gates at Ground openings		Moderate	Remove to enable access to Ground Floor gallery space	Record on measured drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.014	Interview booths		High	Remove to accommodate new gallery	Rebuild in new location	Moderate
17.015	External stair to First Floor		Moderate	Upgrade balustrade to comply with Building Code	Record on measured drawings. Supplement existing balustrade elements with minimal elements if necessary.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.016	Ground Floor main entrance		Low	Retain as existing.	Keep fixed shut if not required for operational use.	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.017	Security screen at Ground Floor main entrance		Low	Remove to accommodate gallery space	Record on measured drawings	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.018	Blue Entrance Gate (facing Old Bailey Street)		High	Retain in situ	Maintain in working order	Neutral
17.019	Blue Entrance Gate (inner) and enclosed yard		Moderate	Retain gate and enclosing walls and roof in situ; remove cupboards.	Repair and maintain gate in working order	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.020	Blue Entrance Gate (inner) facing Prison Yard		Moderate	Retain gate and enclosing frame	Repair and maintain in working order	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.021	Barbed wire		Moderate	Remove	Record on measured drawings. Make good fixing points where attached to brickwork.	Low

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.022	Metal security bars at windows		Moderate	Remove as part of blocking up window openings to accommodate gallery space at First Floor	Record on measured drawings	Low
17.023	External toilets at Ground Floor adjacent East elevation		Low	Remove	Record on measured drawings	Low

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
17.024	Open Visit Room		Low	Space reallocated to other uses	Record on measured drawings. Salvage entrance sign and re-use in new layout of interview booths.	Low

19 Bauhinia House

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.001	Pitched roofs		High	New penetrations through roofs for ventilation ducts and other services	Arrange new penetrations so that they conform with the geometry of the existing roof. Model the size and shape of the new ducts so that the impact on the roofscape is minimised. Finish the new ducts in a non-reflective material that is neutral in colour and mid-tone.	High
19.002	Chimney		High	Repair and retain	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.003	Rainwater goods and other external services		Adverse	Remove and make good wall surface. Replace defective and non- matching rainwater goods with cast iron fittings to match original.	Not applicable	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.004	External stone wall facing		High	Carry out close inspection of painted areas to determine extent of original granite facing and remove paint media where applicable.	Not applicable	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.005	Gun loops		High	Remove concrete infilling and make good stonework where necessary.	Not applicable	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.006	Look-out turret		High	Repair and retain insitu	Not applicable	Neutral

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.007	Windows		Moderate	Remove and make good stonework as necessary	Record existing windows on measured survey drawings	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.008	Modern partitions		Adverse	Remove	Not applicable	Moderate

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.009	Electrical services		Adverse	Remove	Not applicable	Moderate
19.010	Lay-in grid suspended ceiling		Adverse	Remove	Not applicable	High

Central Police Station

Element no.	Description	Photo ref.	Significance	Proposal	Mitigation	Impact
19.011	Exposed timber roof structure		High	Repair and retain insitu	Not applicable	Neutral
19.012	Timber stair		Moderate	Remove	Record on measured surveys drawings	Low