

# Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2

Monthly EM&A Report

June 2018

**Submitted to**

Environmental Protection Department

**Prepared By**

Meinhardt Infrastructure and Environment Ltd

Meinhardt Infrastructure and Environment Limited

**Entrusted Portion of Widening of Tolo  
Highway / Fanling Highway between Island  
House Interchange and Fanling Stage 2**

Monthly EM&A Report

(June 2018)

Certified by: Fredrick Leong 

Position: Environmental Team Leader

Date: 11 July 2018

Hyder-Arup-Black & Veatch Joint Venture  
c/o Arcadis  
20/F, AXA Tower, Landmark East,  
100 How Ming Street,  
Kwun Tong, Hong Kong  
Attn: Mr. James Penny

**Your Reference**

**Our Reference**  
JFP/EC/ST/pl/T329380/22  
.05/L-0222

20/F AIA Kowloon Tower  
Landmark East  
100 How Ming Street  
Kwun Tong  
Kowloon  
Hong Kong

T +852 2828 5757  
F +852 2827 1823  
mottmac.hk

**Environmental Monitoring and Audit (EM&A) for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling Stage 2 (between Tai Hang to Wo Hop Shek Interchange) – Entrusted Works Environmental Permit No. EP-324/2008/E Condition 3.3 – Submission of Monthly EM&A Report – June 2018 for the portion of Stage 2 works entrusted to Civil Engineering and Development Department (CEDD) under Contract No. CV/2012/09**

11 July 2018

By Fax (2805 5028) & Hand

We refer to the Monthly EM&A Report – June 2018 received on 09 July 2018 submitted by the Environmental Team via email. Pursuant to Environmental Permit Condition 3.3, I hereby verify the Monthly EM&A Report – June 2018 (Rev. 0) for the portion of works under Stage 2 of the captioned Project which is entrusted to CEDD under Contract No. CV/2012/09.

Yours faithfully  
for MOTT MACDONALD HONG KONG LIMITED






Steven Tang  
Independent Environmental Checker

c.c.  
HyD  
CEDD/BCP  
AECOM  
Meinhardt

Mr. Chung Lok Chin  
Mr. Lu Pei Yu  
Mr. Alan Lee  
Mr. Fredrick Leong

By Fax (2714 5198)  
By Fax (3547 1659)  
By Fax (3922 9797)  
By Fax (2559 1613)

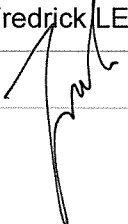Date	Revision	Prepared By	Checked By	Approved By
6 July 2018	0	WK CHIU BoBo HUI	Fredrick LEONG	Helen COCHRANE
				



## Contents

	Page
EXECUTIVE SUMMARY	i
1 INTRODUCTION	1
1.2 Purpose of the Report .....	1
1.3 Report Structure .....	1
2 PROJECT INFORMATION	2
2.1 Background .....	2
2.2 Site Description .....	3
2.3 Construction Programme and Activities .....	3
2.4 Project Organisation .....	3
3 STATUS OF ENVIRONMENTAL LICENSES, NOTIFICATION AND PERMITS	5
4 AIR QUALITY MONITORING	7
4.1 Monitoring Requirement .....	7
4.2 Monitoring Equipment .....	7
4.3 Monitoring Location .....	7
4.4 Monitoring Parameters, Frequency and Duration .....	7
4.5 Monitoring Methodology .....	8
4.6 Monitoring Schedule for the Reporting month .....	8
4.7 Monitoring Results .....	8
5 NOISE MONITORING	10
5.1 Monitoring Requirements .....	10
5.2 Monitoring Equipment .....	10
5.3 Monitoring Locations .....	10
5.4 Monitoring Parameters, Frequency and Duration .....	10
5.5 Monitoring Methodology .....	11
5.6 Monitoring Schedule for the Reporting Month .....	11
5.7 Monitoring Results .....	11
6 WATER MONITORING	13
7 WASTE MANAGEMENT	14
8 ENVIRONMENTAL SITE INSPECTION AND AUDIT	15
8.1 Site Inspection .....	15
9 IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES	16
10 SUMMARY OF EP SUBMISSION IN THE REPORTING MONTH	17
11 ENVIRONMENTAL NON-CONFORMANCE	18
11.1 Summary of Monitoring Exceedances .....	18

11.2	Summary of Environmental Non-Compliance .....	18
11.3	Summary of Environmental Complaints.....	18
11.4	Summary of Environmental Summon and Successful Prosecutions.....	18
12	FUTURE KEY ISSUES	19
12.1	Construction Programme for the Next Month.....	19
12.2	Key Issues for the Coming Month.....	19
12.3	Monitoring Schedule for the Next Month.....	19
13	CONCLUSIONS AND RECOMMENDATIONS	20
13.1	Conclusions.....	20
13.2	Recommendations .....	20

### List of Tables

Table 2.1	Contact Information of Key Personnel
Table 3.1	Status of Environmental Licenses, Notifications and Permits
Table 4.1	Air Quality Monitoring Equipment
Table 4.2	Location of Air Quality Monitoring
Table 4.3	Air Quality Monitoring Parameters, Frequency and Duration
Table 4.4	Summary of 1-hr TSP Monitoring Results
Table 4.5	Summary of 24-hr TSP Monitoring Results
Table 5.1	Noise Monitoring Equipment
Table 5.2	Location of Noise Monitoring
Table 5.3	Noise Monitoring Parameters, Frequency and Duration
Table 5.4	Summary of Noise Monitoring Results
Table 8.1	Observations and Recommendations of Site Audit
Table 10.1	Status of Required Submission under Environmental Permit

### List of Figures

Figure 1	Demarcation of Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling – Stage 2
Figure 2	Air and Noise Monitoring Locations

### List of Appendices

Appendix A	Construction Programme
Appendix B	Project Organization Structure
Appendix C	Calibration Certificates of Monitoring Equipment
Appendix D	EM&A Monitoring Schedules
Appendix E	Meteorological Data Extracted from Hong Kong Observatory
Appendix F	Air Quality Monitoring Results and their Graphical Presentation
Appendix G	Summary of Event and Action Plan
Appendix H	Noise Monitoring Results and their Graphical Presentation
Appendix I	Not Used
Appendix J	Not Used
Appendix K	Waste Flow Table
Appendix L	Implementation Schedule of Environmental Mitigation Measures (EMIS)
Appendix M	Not Used
Appendix N	Statistics on Complaints, Notifications of Summons and Successful Prosecutions

## EXECUTIVE SUMMARY

The Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2 (hereafter called “the Project”) covers part of the construction of the widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling which aimed to widen Tolo Highway and Fanling Highway to dual 4-lane carriageway in order to alleviate the current traffic congestion problems and to cope with the increasing transport demands to and from the urban areas and also cross boundary traffic. The Project covers construction activities at Yuen Leng along the existing Fanling Highway.

The impact EM&A for the Project includes air quality, noise and water quality monitoring. The EM&A programme commenced on 5 November 2013.

This report documents the findings of EM&A works conducted in June 2018. As informed by the Contractor, the major activities in the reporting month were:

- Cable detection and trial trenches;
- Remaining works on new Footbridge;
- Noise barrier construction;
- Road pavement works;
- Water main laying works (on Grade and on bridge deck);
- Installation of Noise barrier steel column & panel, and sign gantry (on Grade and on bridge deck);
- Parapet Installation on bridge deck;
- Road Drainage Works;
- Construction of profile barrier & Planter wall on Bridge deck;
- Stressing of external tendon;
- Bitumen paving on bridge deck;
- Installation of deck cell light inside the bridge deck;
- Installation of movement joint on the bridge;
- Construction of retaining wall;
- Landscaping works.

### *Breach of Action and Limit Levels for Air Quality*

No exceedance of Action and Limit Level was recorded for 24-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.

No exceedance of Action and Limit Level was recorded for 1-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.

### *Breach of Action and Limit Levels for Noise*

No noise complaint was received in the reporting month, so no Action Level exceedance was recorded. Also, no Limit Level exceedance of noise monitoring was recorded in the reporting month.

### *Breach of Action and Limit Levels for Water Quality*

The box culvert works have been completed in the end of March 2017. The 4-week post construction water quality monitoring has been completed in the end of April 2017 in the same manner as the impact monitoring.

### *Complaint, Notification of Summons and Successful Prosecution*

No complaint, notification of summons and successful prosecution was received in the reporting month.

### *Future Key Issues*

The major construction works in the coming reporting month are anticipated to include:

- Cable detection and trial trenches;
- Remaining works on new Kiu Tau Footbridge;
- Noise barrier construction;
- Road pavement works;
- Water main laying works (on Grade and on bridge deck);
- Installation of Noise barrier steel column & panel, and sign gantry (on Grade and on bridge deck);
- Parapet Installation on bridge deck;
- Road Drainage Works;
- Construction of profile barrier & Planter wall on Bridge deck;
- Stressing of external tendon;
- Bitumen paving on bridge deck;
- Installation of deck cell light inside the bridge deck;
- Installation of movement joint on the bridge;
- Construction of retaining wall;
- Landscaping works.

Potential environmental impacts arising from the above construction activities are anticipated to be mainly associated with construction dust, noise, water quality and waste management.

## **1 INTRODUCTION**

1.1.1 Chun Wo Construction & Engineering Co Ltd (Chun Wo) was commissioned by the Civil Engineering and Development Department (CEDD) as the Civil Contractor for the Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2. Meinhardt Infrastructure & Environment Ltd (MIEL) has been appointed by Chun Wo as the Environmental Team (ET) to fulfill the corresponding EM&A requirements pursuant to Environmental Permit No. EP-324/2008/E in accordance with the Updated EM&A Manual (dated October 2013) for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling Stage 2. The EM&A programme commenced on 5 November 2013.

### **1.2 Purpose of the Report**

1.2.1 This is the monthly EM&A Report which summaries the impact monitoring results and audit findings for the Project during the reporting month of June 2018.

### **1.3 Report Structure**

1.3.1 This monthly EM&A Report comprises the following sections:

Section 1: Introduction

Section 2: Project Information

Section 3: Status of Environmental Licenses, Notifications and Permits

Section 4: Air Quality Monitoring

Section 5: Noise Monitoring

Section 6: Water Monitoring

Section 7: Waste Management

Section 8: Environmental Site Inspection and Audit

Section 9: Implementation Status of Environmental Mitigation Measures

Section 10: Summary of EP Submission in the Reporting Month

Section 11: Environmental Non-Conformance

Section 12: Future Key Issues

Section 13: Conclusions and Recommendations

## 2 PROJECT INFORMATION

### 2.1 Background

- 2.1.1 Tolo Highway and Fanling Highway are expressways in the North East New Territories connecting Sha Tin, Tai Po and Fanling. These highways form a vital part of the strategic Route 1, which links Hong Kong Island to Shenzhen. At present, this section of Route 1 is a dual 3-lane carriageway. However, at several major interchanges along this section of Route 1, the highway is only dual-2 lane. Severe congestion is a frequent occurrence during peak periods, particularly in the Kowloon bound direction.
- 2.1.2 The objective of the Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling is to widen Tolo Highway and Fanling Highway to dual 4-lane carriageway in order to alleviate the current traffic congestion problems and to cope with the increasing transport demands to and from the urban areas and also cross boundary traffic.
- 2.1.3 The construction works for the Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling are to be delivered in 2 stages:
- Stage 1 – Construction works between Island House Interchange and Tai Hang; and
- Stage 2 – Construction works between Tai Hang and Wo Hop Shek Interchange.
- 2.1.4 The construction works of Stage 1 under the EP commenced in November 2009 and was planned to be completed in December 2013 tentatively. The works of Stage 2 was planned to commence in November 2013 and complete by end of 2016. Hyder-Arup-Black and Veatch Joint Venture (HABVJV) was appointed by the Highways Department (HyD) as the consultants for the design and construction assignment for the Project. Mott MacDonald Hong Kong Ltd is the Independent Environmental Checker (IEC) of both Stage 1 and Stage 2 works.
- 2.1.5 A portion of Stage 2 works of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling (hereafter called “the Project”) is entrusted to the contractor of Contract No. CV/2012/09 Liantang / Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works Contract 3, i.e. Chun Wo. AECOM Asia Co Ltd was appointed by the CEDD as the consultant for the design and construction assignment for the Liantang development.
- 2.1.6 The Project is a Designated Project under the Environmental Impact Assessment Ordinance (EIAO) (Cap. 499). An Environmental Impact Assessment (EIA) Report together with an Environmental Monitoring and Audit (EM&A) Manual were approved on 14 July 2000 (Register Number: EIA-043/2000). The Project is governed by an Environmental Permit (EP) (EP-324/2008) which was granted on 23 December 2008. A variation of EP (VEP) was applied and the VEP (EP-324/2008/A) was subsequently granted on 31 January 2012. An additional VEP has been applied on 24 February 2014 and the VEP (EP-324/2008/B) was subsequently granted on 17 March 2014. Furthermore, an additional VEP has been applied on 9 March 2015 and the VEP (EP-324/2008/C) was subsequently granted on 27 March 2015. The previous VEP (EP-324/2008/D) was granted on 27 August 2015. The current VEP (EP-324/2008/E) was granted on 26 January 2017.

## **2.2 Site Description**

2.2.1 The major construction activities under the Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2 include:

At-Grade Road Works – Temporary and permanent road formation, pipe laying, road drainage, footpath and noise barrier construction;

Demolition of existing Kiu Tau Footbridge and Footbridge Re-provision; and

Box Culvert Extension – Flow diversion of existing stream, excavation, sub-base and blinding, base, wall and top slab construction.

2.2.2 **Figure 1** shows the works areas for the Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2.

## **2.3 Construction Programme and Activities**

2.3.1 The major construction activities undertaken in the reporting month are summarized below:

- Cable detection and trial trenches;
- Remaining works on new Footbridge;
- Noise barrier construction;
- Road pavement works;
- Water main laying works (on Grade and on bridge deck);
- Installation of Noise barrier steel column & panel, and sign gantry (on Grade and on bridge deck);
- Parapet Installation on bridge deck;
- Road Drainage Works;
- Construction of profile barrier & Planter wall on Bridge deck;
- Stressing of external tendon;
- Bitumen paving on bridge deck;
- Installation of deck cell light inside the bridge deck;
- Installation of movement joint on the bridge
- Construction of retaining wall;
- Landscaping works.

2.3.2 The construction programme is presented in **Appendix A**.

## **2.4 Project Organisation**

2.4.1 The project organization structure is shown in **Appendix B**. The key personnel contact names and numbers for the Project are summarised in **Table 2.1**.

**Table 2.1 Contact Information of Key Personnel**

Party	Role	Position	Name	Telephone	Fax
AECOM	Engineer's Representative	Senior Resident Engineer	Mr. Alan Lee	2171 3303	2171 3498
		Resident Engineer (Environmental)	Mr. Perry Yam	2171 3350	
Mott MacDonald	Independent Environmental Checker (IEC)	IEC	Mr. Steven Tang	2828 5920	2827 1823
Chun Wo	Contractor	Site Agent	Mr. Daniel Ho	2638 6144	2638 7077
		Environmental Officer	Ms. Tiffany Tsang	2638 6150	
Meinhardt	Environmental Team (ET)	ET Leader	Mr. Fredrick Leong	2859 1739	2540 1580



### 3 STATUS OF ENVIRONMENTAL LICENSES, NOTIFICATION AND PERMITS

3.1.1 The relevant environmental licenses, permits and/or notifications on environmental protection for this Project and valid in the reporting month are summarized in **Table 3.1**.

**Table 3.1 Status of Environmental Licenses, Notifications and Permits**

Permit / License No. / Notification / Reference No.	Valid Period		Status	Remarks
	From	To		
<b>Environmental Permit</b>				
EP-324/2008/E	26 Jan 2017	--	Granted on 26 Jan 2017	
<b>Construction Noise Permit</b>				
GW-RN0785-17	19 Dec 2017	16 Jun 2018	Valid	For road diversion and maintenance of Fanling Highway bothbound
GW-RN0786-17	19 Dec 2017	18 Jun 2018	Valid	For lane shifting work of Fanling Highway bothbound
GW-RN0801-17	22 Dec 2017	21 Jun 2018	Valid	For dismantling of catch fence with MTRr protect Zone at Tong Hang Tung Chuen
GW-RN0863-17	17 Jan 2018	5 Jul 2018	Valid	For loading and unloading along Fanling Highway both bounds
GW-RN0043-18	25 Feb 2018	24 Aug 2018	Valid	For general works at the northward of site office
GW-RN0044-18	22 Feb 2018	21 Aug 2018	Valid	For traverse stitch joints and installation of longitudinal stitch panel over Fanling Highway and MTRC's East Rail Line
GW-RN0102-18	14 Mar 2018	31 Aug 2018	Valid	Parapet Installation Works and Remedial Works on Tai Wo Service Road East, Fanling Highway and MTRC's East Rail Line
GW-RN0123-18	28 Mar 2018	5 Sep 2018	Valid	For general works at the southward of site office
GW-RM0259-18	19 Jun 2018	17 Dec 2018	Valid	For lane shifting work of Fanling Highway both bound

Permit / License No. / Notification / Reference No.	Valid Period		Status	Remarks
	From	To		
GW-RN305-18	22 Jun 2018	17 Dec 2018	Valid	For road diversion and maintenance of Fanling Highway both bound
<b><i>Wastewater Discharge License</i></b>				
WT00016832-2013	28 Aug 2013	31 Aug 2018	Valid	--
<b><i>Chemical Waste Producer Registration</i></b>				
5113-634-C3817-01	7 Oct 2013	--	Valid	--
<b><i>Billing Account for Construction Waste Disposal</i></b>				
7017914	2 Aug 2013	--	Account Active	--
<b><i>Notification Under Air Pollution Control (Construction Dust) Regulation</i></b>				
--	31 Jul 2013	30 Jul 2019	Notified	--

## 4 AIR QUALITY MONITORING

### 4.1 Monitoring Requirement

4.1.1 In accordance with the Updated EM&A Manual, 1-hr and 24-hr total suspended particulate (TSP) levels at the designated air quality monitoring station are required. Impact 24-hour TSP monitoring should be carried out for at least once every 6 days. For the 1-hr TSP impact monitoring, the sampling frequency of at least three times in every 6 days should be undertaken when the highest dust impact occurs.

### 4.2 Monitoring Equipment

4.2.1 The 1hr- TSP and 24-hr TSP air quality monitoring were performed using a High Volume Sampler (HVS), of which its location and operation satisfy, as far as practicable, all the requirements as specified in the Updated EM&A Manual. The brand and model of the equipment are given in **Table 4.1**.

**Table 4.1 Air Quality Monitoring Equipment**

Equipment	Brand and Model	Quantity	Serial Number
High Volume Sampler (1-hr TSP and 24-hr TSP)	Tisch Total Suspended Particulate Mass Flow Controlled High Volume Air Sampler (Model No. TE-5170 MFC)	1	2359

4.2.2 The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.

4.2.3 Calibration of the HVS (five point calibration) using Calibration Kit was carried out every two months. The HVS calibration orifice will be calibrated annually. Calibration certificate of the TE-5025A Calibration Kit and the HVS are provided in **Appendix C**.

### 4.3 Monitoring Location

4.3.1 Air quality monitoring was conducted at the location specified in the Updated EM&A Manual. **Table 4.2** describes the details of the air quality monitoring station with its location as shown in **Figure 2**.

**Table 4.2 Location of Air Quality Monitoring**

Air Monitoring Station ID	Monitoring Location	Description
AM1(SR77) *	Yuen Leng 2 *	Residential, Ground floor

Remark:

\* Location and Station / ASR ID as identified in Updated EM&A Manual / EIA Report for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling

### 4.4 Monitoring Parameters, Frequency and Duration

4.4.1 **Table 4.3** summarizes the monitoring parameters, frequency and duration of impact TSP monitoring.

**Table 4.3 Air Quality Monitoring Parameters, Frequency and Duration**

Parameter	Frequency and Duration
1-hour TSP	At least three times in every 6 days should be undertaken when the highest dust impact occur
24-hour TSP	Once every 6 days

#### 4.5 Monitoring Methodology

##### *1-hr and 24-hr TSP Monitoring*

- 4.5.1 With the consideration of criteria stated in the Updated EM&A Manual, the HVS was installed in the vicinity of the air sensitive receivers.
- 4.5.2 The relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and any special phenomena observed were recorded. The weather information was referenced from Hong Kong Observatory (<http://www.weather.gov.hk/wxinfo/pastwx/extractc.htm>).
- 4.5.3 A HOKLAS accredited laboratory with constant temperature and humidity control, and equipped with necessary measuring and conditioning instruments, to handle the 24-hr TSP samples, was employed for sample analysis.
- 4.5.4 Filter papers of size 8"x10" were labelled before sampling. They were inspected to be clean with no pin holes and conditioned in a humidity controlled chamber for over 24-hr and were pre-weighed before use for the sampling.
- 4.5.5 The 24-hr TSP levels were measured by following the standard high volume sampling method for TSP as set out in the Title 40 of the United States Code of Federal Regulations, Chapter 1 (Part 50), Appendix B. TSP was sampled by drawing air through a conditioned, pre-weighed filter paper inside the HVS at a controlled air flow rate. After 24-hr sampling, the filter papers loaded with dust were kept in a clean and tightly sealed plastic bag, and then returned to the laboratory for reconditioning in the humidity controlled chamber followed by accurate weighing by an electronic balance with a readout down to 0.1 mg.
- 4.5.6 All the collected samples were kept in a good condition for 6 months before disposal.
- 4.5.7 For 1-hr TSP monitoring, monitoring methodology is the same as 24-hr TSP monitoring which has been presented in **Section 4.5.1** to **Section 4.5.6**, but with sampling period changed to 1 hour.

#### 4.6 Monitoring Schedule for the Reporting month

- 4.6.1 The schedule for environmental monitoring for the reporting month is provided in **Appendix D**. Meteorological data extracted from Hong Kong Observatory for the reporting month is provided in **Appendix E**.

#### 4.7 Monitoring Results

- 4.7.1 The monitoring results for 1-hr and 24-hr TSP are summarised in **Table 4.4** and **Table 4.5** respectively. Detailed air quality monitoring results and the graphical presentation

of air quality monitoring data for the current and past three reporting months are presented in **Appendix F**.

**Table 4.4 Summary of 1-hr TSP Monitoring Results**

ASR ID	Average ( $\mu\text{g}/\text{m}^3$ )	Range ( $\mu\text{g}/\text{m}^3$ )	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )
AM1(SR77) *	115.6	95.8 – 151.2	292.7	500

Remark:

\* Station / ASR ID as identified in Updated EM&A Manual / EIA Report for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling

**Table 4.5 Summary of 24-hr TSP Monitoring Results**

ASR ID	Average ( $\mu\text{g}/\text{m}^3$ )	Range ( $\mu\text{g}/\text{m}^3$ )	Action Level ( $\mu\text{g}/\text{m}^3$ )	Limit Level ( $\mu\text{g}/\text{m}^3$ )
AM1(SR77) *	47.8	18.9 – 66.1	170.3	260

Remark:

\* Station / ASR ID as identified in Updated EM&A Manual / EIA Report for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling

- 4.7.2 No exceedance of Action and Limit Level was recorded for 24-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.
- 4.7.3 No exceedance of Action and Limit Level was recorded for 1-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.
- 4.7.4 The Event and Action Plan for the occurrence of non-compliance of the air quality criteria is annexed in **Appendix G**.

## 5 NOISE MONITORING

### 5.1 Monitoring Requirements

5.1.1 In accordance with the Updated EM&A Manual, the impact noise monitoring frequency shall depend on the scale of the construction activities. An initial guide on the regular monitoring frequency should be at least once per week when noise generating activities are underway.

### 5.2 Monitoring Equipment

5.2.1 Noise monitoring was performed using a sound level meter at the monitoring station. The sound level meter deployed complies with the International Electrotechnical Commission Publications 651:1979 (Type 1) and 804:1985 (Type 1) specifications. An acoustic calibrator was deployed to check the sound level meter at a known sound pressure level. The brand and model of the equipment is given in **Table 5.1**.

**Table 5.1 Noise Monitoring Equipment**

Equipment	Brand and Model	Quantity	Serial Number
Sound Level Calibrator	Rion (Model No. NC-74)	1	34857296
Sound Level Meter	Rion (Model No. NL-52)	1	00821072

5.2.2 The sound level calibrator and sound level meter were verified by a certified laboratory every year. Calibration certificates of the sound level meter and acoustic calibrator are provided in **Appendix C**.

### 5.3 Monitoring Locations

5.3.1 Impact noise monitoring was conducted at the location specified in the Updated EM&A Manual. **Table 5.2** describes the details of the noise monitoring station with its location as shown in **Figure 2**.

**Table 5.2 Location of Noise Monitoring**

NSR ID	Monitoring Location	Description
M1(SR77) *	Yuen Leng 2 *	Residential, Ground floor

Remark:

\* Location and Station / NSR ID as identified in Updated EM&A Manual / EIA Report for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling

### 5.4 Monitoring Parameters, Frequency and Duration

5.4.1 **Table 5.3** summarizes the monitoring parameters, frequency and duration of impact noise monitoring.

**Table 5.3 Noise Monitoring Parameters, Frequency and Duration**

Parameter and Duration	Frequency
30-mins measurement at between 0700 and 1900 on normal weekdays. Leq, L10 and L90 would be recorded.	At least once per week

## 5.5 Monitoring Methodology

5.5.1 The monitoring procedures are summarised as follows:

- The sound level meter was set on a tripod at a height of 1.2 m above the ground for free-field measurements at monitoring station SR77;
- The battery condition was checked to ensure good functioning of the meter;
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - Frequency weighting: A
  - Time weighting: Fast
  - Parameters: Leq, L10 and L90
  - Time measurement: Leq(30-minutes) during non-restricted hours i.e. 07:00 – 19:00 hrs on normal weekdays
- Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator for 94dB(A) at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- At the end of the monitoring period, the Leq, L10 and L90 were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- A façade correction of +3dB (A) shall be made to the noise parameter obtained by free field measurement.

## 5.6 Monitoring Schedule for the Reporting Month

5.6.1 The schedule for environmental monitoring for the reporting month is provided in **Appendix D**. Meteorological data extracted from Hong Kong Observatory for the reporting month is provided in **Appendix E**.

## 5.7 Monitoring Results

5.7.1 The monitoring results for noise are summarized in **Table 5.4** and the monitoring results and the graphical presentation of noise level for the current and past three reporting months are presented in **Appendix H**.

**Table 5.4 Summary of Noise Monitoring Results**

Noise Monitoring Station ID	Average, dB(A), Leq (30min) <sup>(2)</sup>	Range, dB(A), Leq (30min) <sup>(2)</sup>	Action Level	Limit Level, dB(A)
M1(SR77) <sup>(1)</sup>	68.0	62.0 – 72.0	When one documented valid complaint is received	75

Remark:

(1) Station / NSR ID as identified in Updated EM&A Manual / EIA Report for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling

(2) +3dB(A) façade correction included

- 5.7.2 Major noise sources during the noise monitoring included construction activities of the Project and that along Tai Wo Service Road East, and nearby traffic noise.
- 5.7.3 No noise complaint was received in the reporting month, so no Action Level exceedance was recorded. Also, no Limit Level exceedance of noise monitoring was recorded in the reporting month.
- 5.7.4 The Event and Action Plan for the occurrence of non-compliance of the noise criteria is annexed in **Appendix G**.



## **6 WATER MONITORING**

- 6.1.1 The box culvert works had been completed in March 2017. The 4-week post-construction water quality monitoring at I5 was completed in 28 April 2017.

## 7 WASTE MANAGEMENT

- 7.1.1 The Contractor has registered as a chemical waste producer of the Project. The C&D materials and waste sorting were carried out on-site. Receptacles were provided for general refuse collection.
- 7.1.2 As advised by the Contractor, a total of 862m<sup>3</sup> of excavated material has been generated. 265m<sup>3</sup> of inert C&D materials was disposed of at public fill to Tuen Mun Area 38. 515m<sup>3</sup> inert C&D materials were reused on site. 110m<sup>3</sup> of general refuse was disposed of at North East New Territories (NENT) Landfill. No plastic was collected by recycling contractor in the reporting month. No paper/cardboard packaging was collected by recycling contractor in the reporting month. No metal was collected by recycling contractor in the reporting month. No chemical waste was collected by licensed contractor in the reporting period. Details of the waste management data are presented in **Appendix K**.

## 8 ENVIRONMENTAL SITE INSPECTION AND AUDIT

### 8.1 Site Inspection

- 8.1.1 Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. A summary of the site inspection is provided in **Appendix L**.
- 8.1.2 In the reporting month, 4 site inspections were carried out on 7, 14, 20 and 28 June 2018. The one held on 28 June 2018 was a joint inspection with the IEC, ER, ET and Contractor. On 28 June 2018 site inspection, Towngas works area was suspected to pump water into Chun Wo site boundary and the follow up action will be reviewed in the next site inspection and reporting in the next month. No site inspection was conducted by the EPD during the reporting month. No non-compliance was recorded during the site inspection. A summary of the reminders and observations recorded during the site inspections are presented in **Table 8.1**.

**Table 8.1 Observations and Recommendations of Site Audit**

Parameters	Date	Observations and Recommendations	Follow-up
Air Quality	N/A	N/A	N/A
Noise	N/A	N/A	N/A
Water Quality	7 June 2018	Reminder: The contractor was reminded the wastewater should be removed and treated properly prior to discharge in accordance with WPCO License.	Wastewater was removed on 20 June 2018. (item closed)
Waste/ Chemical Management	7 June 2018	Observation: Waste was observed at near noise barrier 69. The contractor was advised to remove the waste and prevent accumulation.	Accumulated waste was removed at near noise barrier 69 on 7 June 2018. (item closed)
Landscape & Visual	N/A	N/A	N/A
Permits / Licenses	N/A	N/A	N/A

## **9 IMPLEMENTATION STATUS OF ENVIRONMENTAL MITIGATION MEASURES**

- 9.1.1 The Contractor has implemented the relevant environmental mitigation measures as specified in the EIA Reports, EPs and updated EM&A Manual. The implementation status of environmental mitigation measures during the reporting period is summarized in **Appendix L**.

## 10 SUMMARY OF EP SUBMISSION IN THE REPORTING MONTH

10.1.1 The status of the required submission under the EP during the reporting period is summarized in **Table 10.1**.

**Table 10.1 Status of Required Submission under Environmental Permit**

EP Condition	Submission	Submission Date
Condition 3.3	Monthly EM&A Report for May 2018	11 June 2018

## **11 ENVIRONMENTAL NON-CONFORMANCE**

### **11.1 Summary of Monitoring Exceedances**

- 11.1.1 No exceedance of Action and Limit Level were recorded for 24-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.
- 11.1.2 No exceedance of Action and Limit Level was recorded for 1-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.
- 11.1.3 No noise complaint was received in the reporting month, so no Action Level exceedance was recorded. Also, no Limit Level exceedance of noise monitoring was recorded in the reporting month.
- 11.1.4 The 4-week post-construction water quality monitoring at I5 was completed in April 2017.

### **11.2 Summary of Environmental Non-Compliance**

- 11.2.1 No environmental non-compliance was recorded in the reporting month. The cumulative statistics are provided in **Appendix N**.

### **11.3 Summary of Environmental Complaints**

- 11.3.1 No environmental complaints were received in the reporting month. The cumulative statistics are provided in **Appendix N**.

### **11.4 Summary of Environmental Summon and Successful Prosecutions**

- 11.4.1 No environmental related prosecution or notification of summons was received in the reporting month. The cumulative statistics are provided in **Appendix N**.

## 12 FUTURE KEY ISSUES

### 12.1 Construction Programme for the Next Month

12.1.1 The major construction works in the coming reporting month are anticipated to include:

- Cable detection and trial trenches;
- Remaining works on new Footbridge;
- Noise barrier construction;
- Road pavement works;
- Demolition of Existing Kiu Tau Vehicular Bridge;
- Water main laying works (on Grade and on bridge deck);
- Installation of Noise barrier steel column & panel, and sign gantry (on Grade and on bridge deck);
- Parapet Installation on bridge deck;
- Road Drainage Works;
- Construction of profile barrier & Planter wall on Bridge deck;
- Stressing of external tendon;
- Bitumen paving on bridge deck;
- Installation of deck cell light inside the bridge deck;
- Installation of movement joint on the bridge;
- Construction of retaining wall behind abutment; and
- Landscaping works.

### 12.2 Key Issues for the Coming Month

12.2.1 Key issues to be considered in the coming month are anticipated to include:

- Properly maintain all drainage facilities and wheel washing facilities on site;
- Expose slopes and dusty stockpile should be covered up properly if no work will be conducted;
- Good housekeeping should be maintained and general refuse should be removed regularly; and
- Watering shall be enhanced over the construction site.

### 12.3 Monitoring Schedule for the Next Month

12.3.1 The tentative schedule for environmental monitoring for the coming month is provided in **Appendix D**.

## 13 CONCLUSIONS AND RECOMMENDATIONS

### 13.1 Conclusions

- 13.1.1 The construction phase EM&A programme of the Project commenced on 5 November 2013.
- 13.1.2 The 1-hr TSP, 24-hr TSP, noise and water quality monitoring were carried out in the reporting period.
- 13.1.3 No exceedance of Action and Limit Level was recorded for 24-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.
- 13.1.4 No exceedance of Action and Limit Level was recorded for 1-hour TSP monitoring at the monitoring location AM1(SR77) in the reporting month.
- 13.1.5 No noise complaint was received in the reporting month, so no Action Level exceedance was recorded. Also, no Limit Level exceedance of noise monitoring was recorded in the reporting month.
- 13.1.6 The 4-week post-construction water quality monitoring at I5 was completed in April 2017.
- 13.1.7 Four (4) environmental site inspections were carried out in the reporting month. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site audit.

### 13.2 Recommendations

- 13.2.1 According to the environmental site inspections performed in the reporting month, the following recommendation was provided:

#### *Water Quality*

Wastewater shall be removed and treated properly prior to discharge in accordance with WPCO License.


#### *Waste Management*

Wastes shall be removed to prevent accumulation.




**Figure**



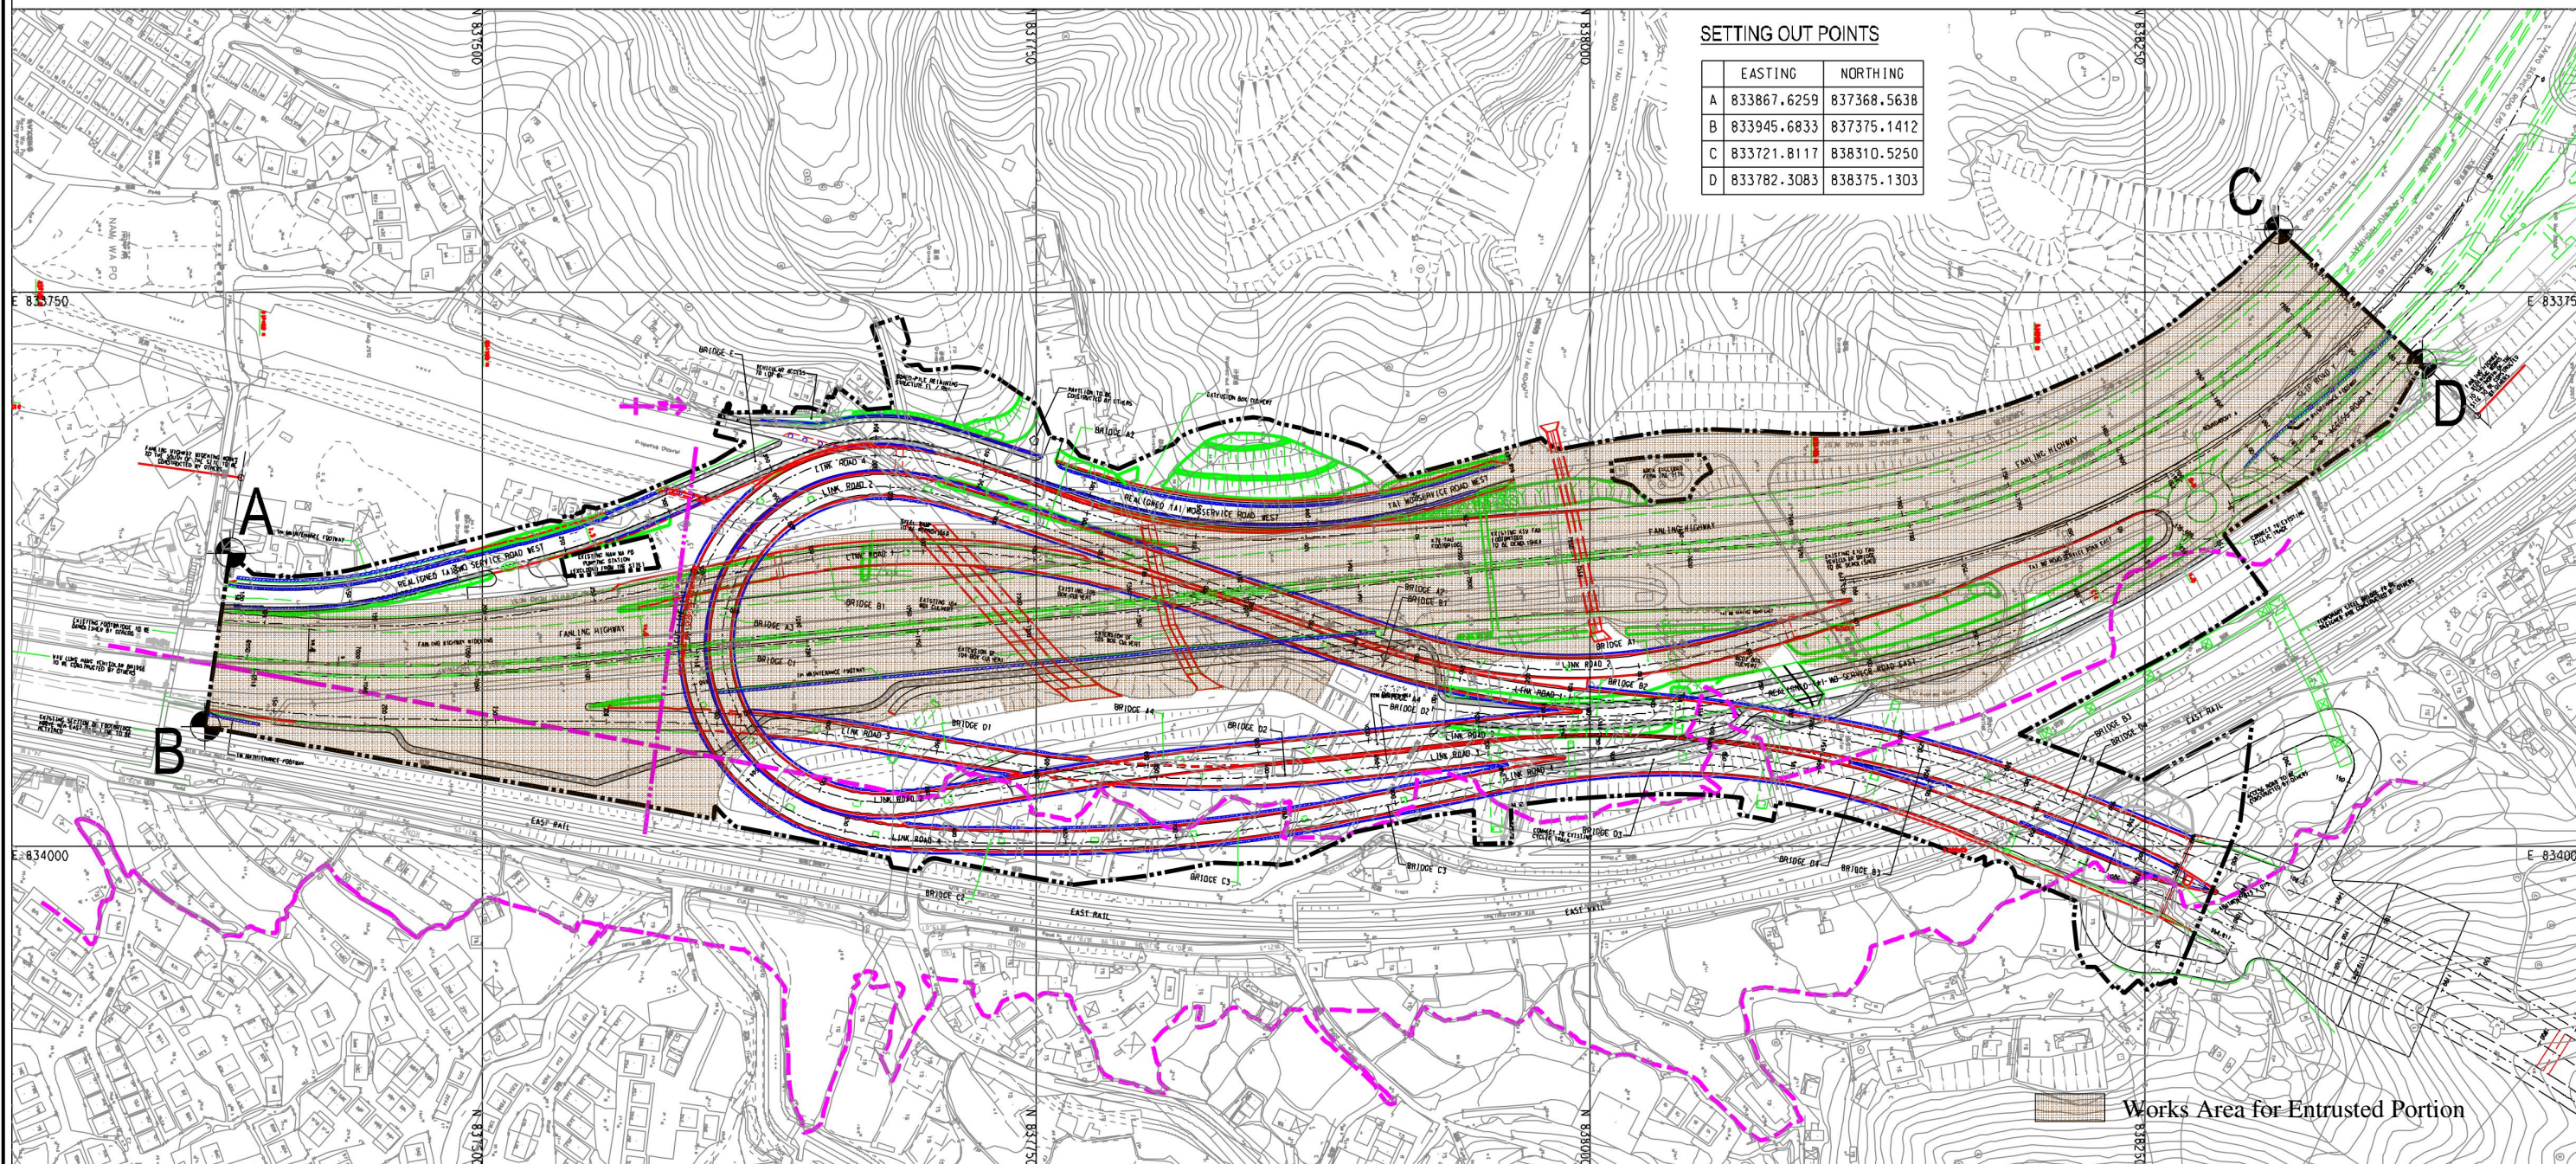

CV/201209-T-CWC-SK-001g\_AD\_edit.dgn 22/1/2014 17:10:34



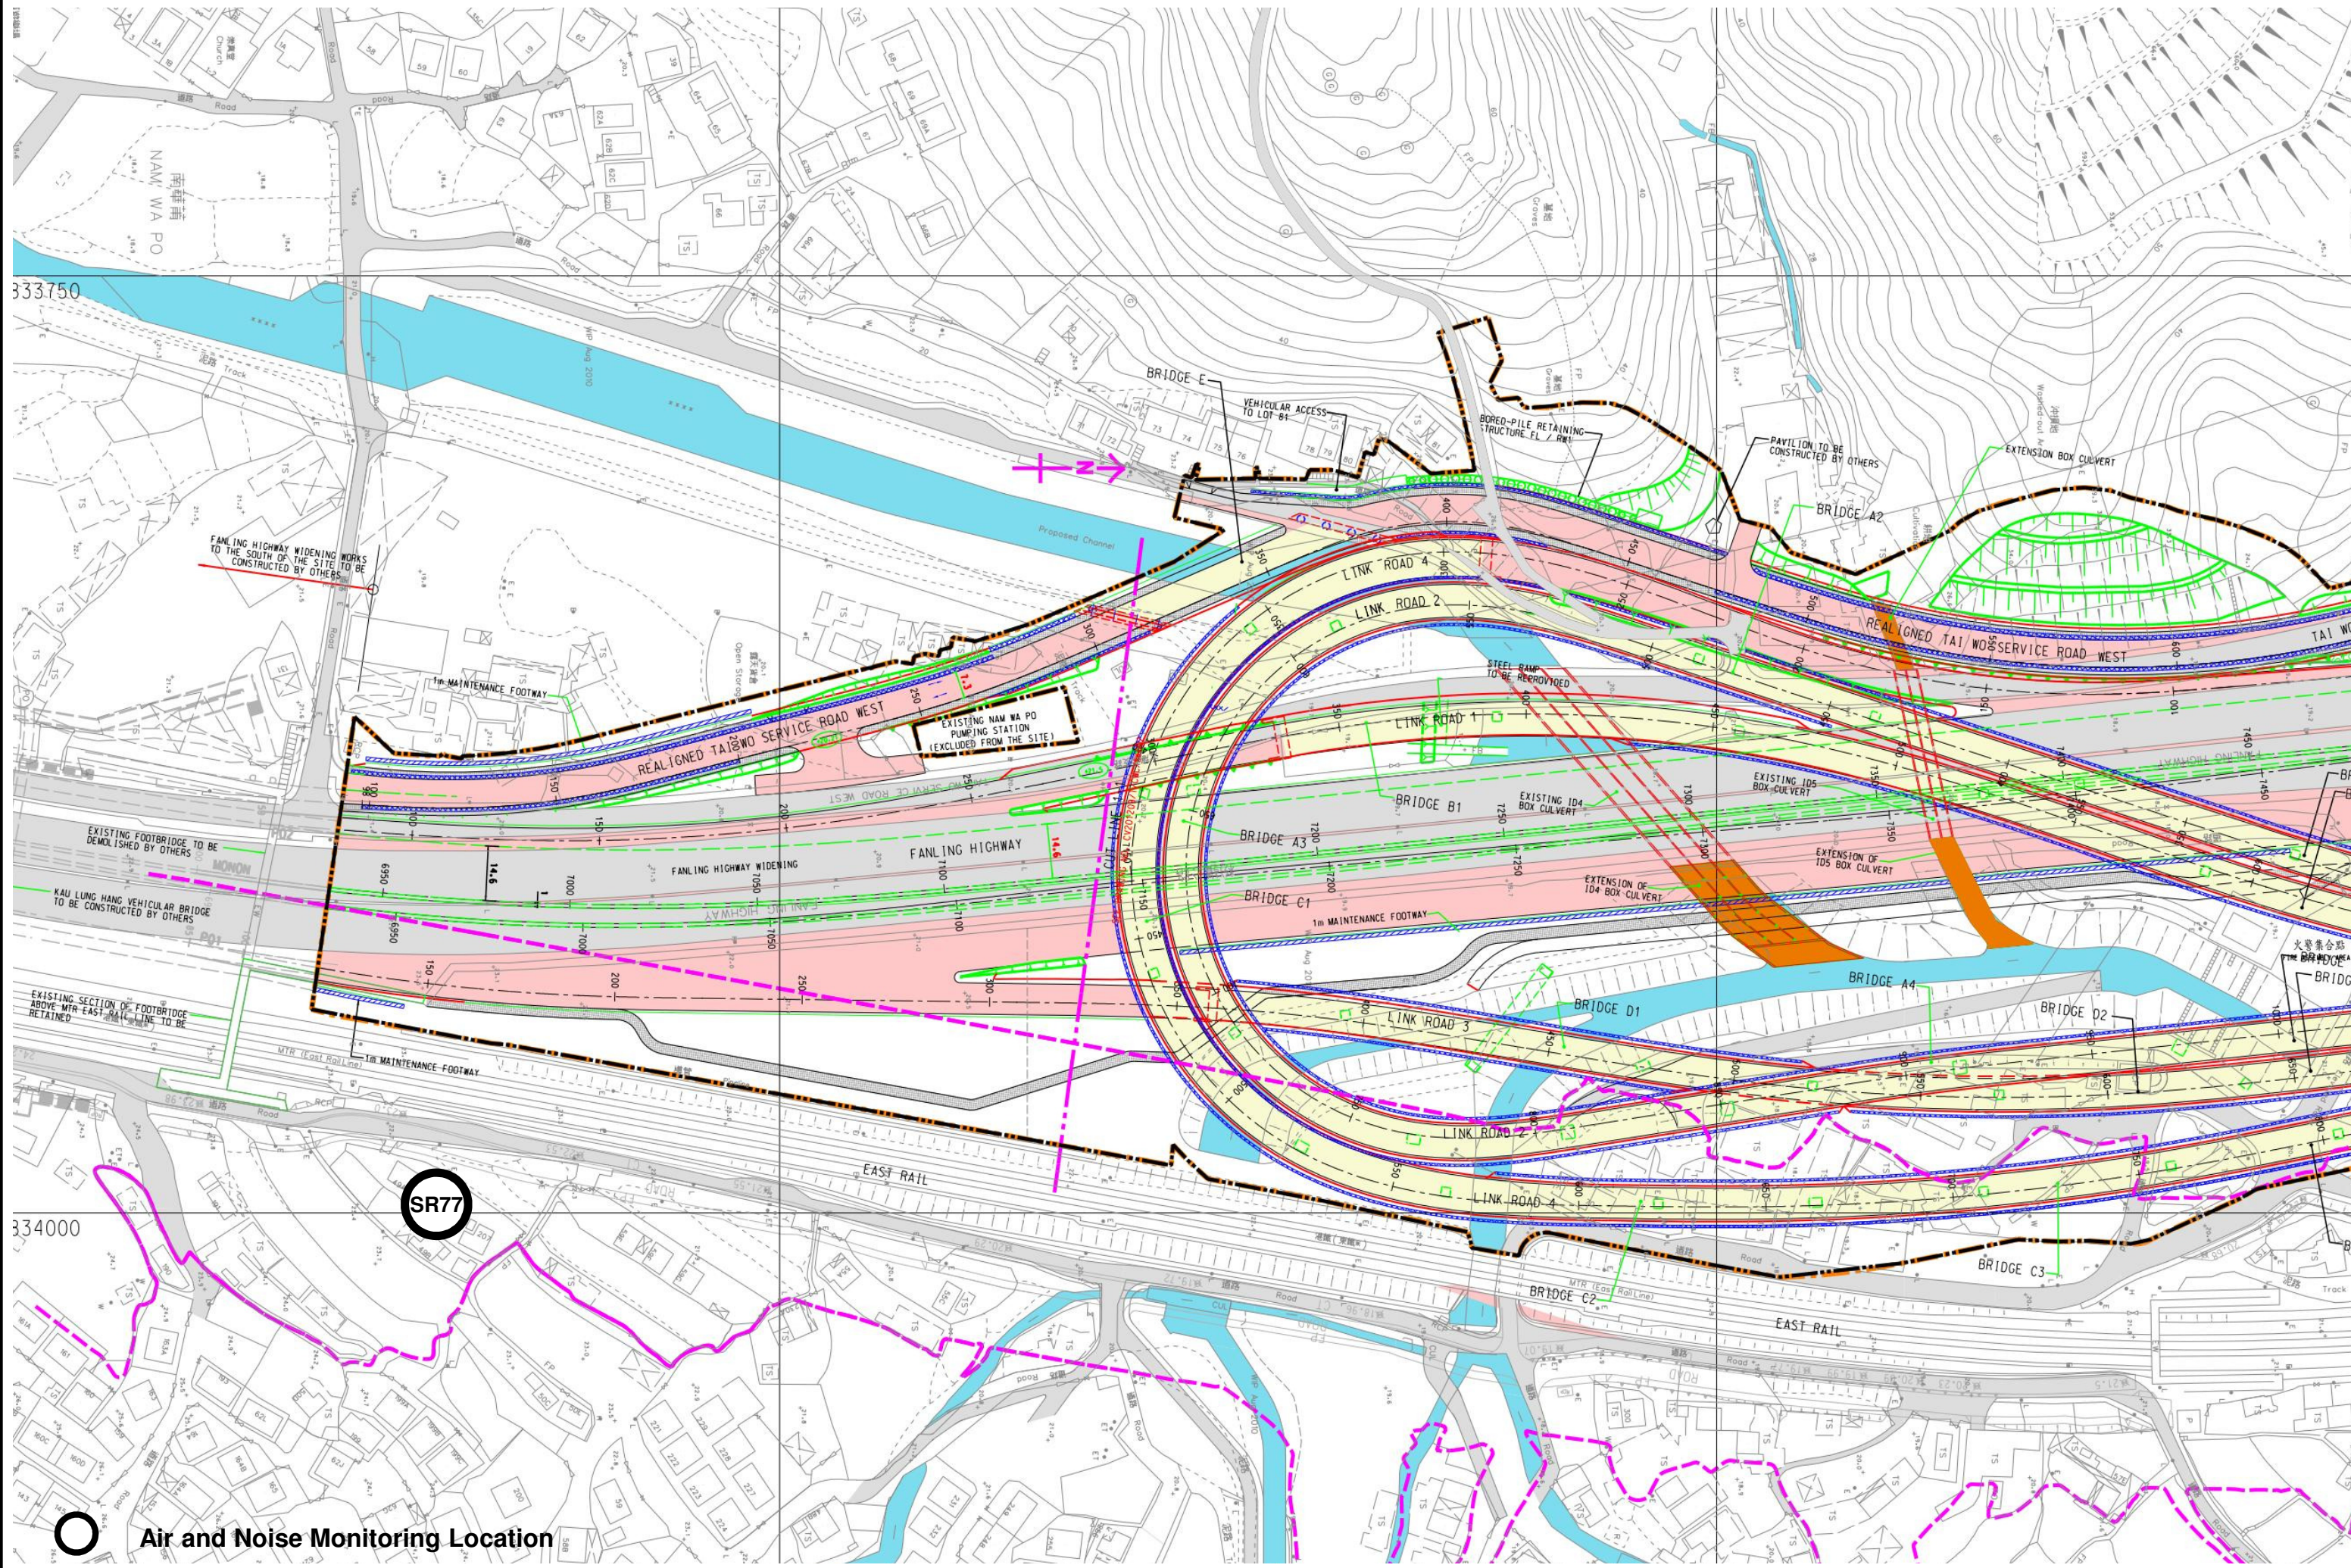



# Appendix A Construction Programme

Activity ID	Activity Name	OD	RD	Start	Finish	TF	2018						
							May	Jun	Jul	Aug	Sep	Oct	
<b>3-Month Rolling Programme 2018-5-21 (Based on UMP06C)</b>													
<b>Key Dates (Contractual)</b>													
KD-0100b	KD1: Section 1A - all HyD's works in Zone3 & SBZ2 excl. Landscape Works (Potential EOT by Claim 63)	0	0	03-Sep-18*	0							◆ KD1: Section 1A - all HyD's works in Zone3 &	
KD-0200	KD2: Section 1B - all HyD's entrustment works in NBZ1 excluding Landscape Softworks and Establishment Works	0	0	04-Sep-18*	0							◆ KD2: Section 1B - all HyD's entrustment wor	
KD-0300a	KD3: Section 2 - the remainder of the Works (Preliminary EOT by Claim No.56 & 58)	0	0	07-Aug-18*	0							◆ KD3: Section 2 - the remainder of the Works (Preliminary EOT by Claim No.56 & 58)	
KD-0400a	KD4: Section 3 - Remainder of Landscape Softworks not included in Section 3A (Prel. EOT by Claim 56, 58)	0	0	03-Sep-18*	0							◆ KD4: Section 3 - Remainder of Landscape So	
KD-0500	KD4A: Section 3A - Landscape Softworks in NBZ1	0	0	03-Sep-18*	0							◆ KD4A: Section 3A - Landscape Softworks in N	
KD-0800	KD6: Section 5 - Preservation and Protection of Trees	0	0	03-Sep-18*	0							◆ KD6: Section 5 - Preservation and Protection	
<b>Dependent Milestones from Other Contracts</b>													
<b>Related to North Buffer Zone</b>													
MS-NB2120	Shift existing FLH NB Middle Lane to future 1st Lane by FHW3 Contractor (NBZ)	0	0	28-Jul-18*	17							◆ Shift existing FLH NB Middle Lane to future 1st Lane by FHW3 Contractor (NBZ)	
MS-NBZ130	Shift existing FLH NB Fast Lane to future 2nd Lane by FHW3 Contractor (NBZ)	0	0	18-Aug-18*	-10							◆ Shift existing FLH NB Fast Lane to future 2nd Lane by FHW3 Conti	
<b>Major Milestones and Events</b>													
MS-1060e	T6e: TTA to shift FLH SB Fast Lane to the Permanent Alignment (4th lane) (South Portion)	1	1	08-Jul-18*	08-Jul-18	-12						T6e: TTA to shift FLH SB Fast Lane to the Permanent Alignment (4th lane) (South Portion)	
MS-1060f	T6f: TTA to shift FLH SB Middle Lane to the Permanent Alignment (3rd lane) (South Portion)	1	1	02-Aug-18	02-Aug-18	-11						T6f: TTA to shift FLH SB Middle Lane to the Permanent Alignment (3rd lane) (South Po	
MS-1060h	T6h: TTA to shift FLH SB Slow Lane to the Permanent Alignment (2nd lane) (South Portion)	1	1	28-Aug-18	28-Aug-18	-12						T6h: TTA to shift FLH SB Slow Lane to the Permanent	
<b>Design and Submissions</b>													
<b>Design Confirmation</b>													
PRE-1620	Procurement and Delivery (3 mth) of LED Street Lighting	68	0	16-Jan-18 A	28-May-18 A							Procurement and Delivery (3 mth) of LED Street Lighting	
<b>Method Statement and Design (Major) Approved by AECOM</b>													
PRE-2030	E&M design for Public Lighting of Kiu Tau Footbridge (further comments provided by HyD/Lightings)	60	21	05-Sep-16 A	14-Jul-18	43						E&M design for Public Lighting of Kiu Tau Footbridge (further comments provided by HyD/Lightings), E&M des	
<b>Section IA &amp; IB - Fanling Highway Widening (KD-1 &amp; KD-2)</b>													
<b>Fanling Highway South Portion between CH6935 and CH7470</b>													
<b>Fanling Highway Zone 1 between CH6935 and CH7130 (within SBZ2)</b>													
<b>Noise Barrier</b>													
FHW-1110b	Noise Barrier NB6 and NB7 - Remaining Stem Wall (28m, maintain access for extension of NB 70, VO199)	30	30	13-Aug-18*	15-Sep-18	-11						Noise Barrier NB6 and NB7 - I	
FHW-1140a	Noise Barrier NB70 - Footing adjacent to SB lane (Bay 1 - 3)	42	27	19-Dec-17 A	21-Jul-18	-16						Noise Barrier NB70 - Footing adjacent to SB lane (Bay 1 - 3), Noise Barrier NB70 - Footing adjacent t	
FHW-1140c	Noise Barrier NB70 - Footing (extended 10m under VO199)	47	47	24-Jul-18*	15-Sep-18	-17						Noise Barrier NB70 - Footing	
<b>At-Grade Roadworks (195m)</b>													
FHW-1350a	Road Drainage - MN7.4 & MN7.5 on FLH NB 1st lane (after combined TTA implemented with CSHK)	40	34	15-Jan-18 A	30-Jul-18	16						Road Drainage - MN7.4 & MN7.5 on FLH NB 1st lane (after combined TTA implemented wi	
FHW-1350b	Road Pavement (FLH NB 1st lane and Hard Shoulder)	14	14	31-Jul-18	15-Aug-18	16						Road Pavement (FLH NB 1st lane and Hard Shoulder)	
<b>Fanling Highway Zone 2 between CH7130 and CH7290</b>													
<b>Noise Barrier</b>													
FHW-2110c	Noise Barrier NB71 - Footing adjacent to Abutment AD1 (27m) (Covered by VO.199)	55	55	24-May-18 A	23-Aug-18	9						Noise Barrier NB71 - Footing adjacent to Abutment AD1 (27	
FHW-2340a	Noise Barrier NB67-2 - Cap ID4-1A_2 and Stem Wall	28	28	17-May-18 A	23-Jul-18	4						Noise Barrier NB67-2 - Cap ID4-1A_2 and Stem Wall, Noise Barrier NB67-2 - Cap ID4-1A_2 and S	
FHW-2340b	Noise Barrier NB67-2 - Cap ID4-1A_1 and Cap ID4-1A_2 head beam (affected by Tau Pass, VO 191)	24	24	17-Sep-18	16-Oct-18	-81							
FHW-2370c	Access Ramp at Tau Pass - Additional Mini-Piling (3 nos.) (under VO191)	21	21	20-Jul-18*	13-Aug-18	-81						Access Ramp at Tau Pass - Additional Mini-Piling (3 nos.) (under VO191,	
FHW-2370d	Access Ramp at Tau Pass - Pile caps and other structures (under VO191)	72	72	14-Aug-18*	08-Nov-18	-54							
<b>At-Grade Roadworks (160m)</b>													
FHW-2240	Permanent Street Light Installation (due to Claim No. 63)	21	21	18-Jul-18*	10-Aug-18	9						Permanent Street Light Installation (due to Claim No. 63)	

3-Month Rolling Programme updated to 2018-6-20			
Date	Revision	Checked	Approved





Activity ID	Activity Name	OD	RD	Start	Finish	TF	2018											
							May	Jun	Jul	Aug	Sep	Oct						
FHW-NB-330	Installation of Steelworks & Panel for NB69 (109m), adjacent to FLH NB lanes near LR1 at Zone 3	18	18	09-Aug-18*	29-Aug-18	4												
<b>Erection of Sign Gantry</b>																		
FHW-SG-101C	Fabrication and Delivery of Sign Gantry G33 on FLH NB	99	34	09-Nov-17 A	30-Jul-18	30												
FHW-SG-101C	Erection of Sign Gantry G33 on FLH NB (include On-site Fabrication) (affected by changed location of G33)	15	1	25-May-18 A	20-Jun-18	63												
FHW-SG-102C	Fabrication and Delivery of Sign Gantry G53 on FLH SB	99	0	27-Nov-17 A	30-May-18 A													
FHW-SG-102C	Erection of Sign Gantry G53 on FLH SB (include On-site Fabrication)	15	0	25-May-18 A	25-Jun-18 A													
<b>Section II - Remainder of the Works (KD-3)</b>																		
<b>At Grade Link Road at Fanling Highway Interchange</b>																		
<b>Link Road 1 (near Abutment AB1)</b>																		
FHI-LR1-101I	Allow Contractor of Contract 4 for Installation of TCSS Cable at Abutment AB1	0	0		20-Jun-18*	-17												
FHI-LR1-102I	Backfilling works of abutment, Gully and Profile Barrier at Abutment AB1	20	45	28-May-18 A	11-Aug-18	-34												
FHI-LR1-111C	Road Formation and Pavement (CH 240 - CH 340, nr AB1)	30	30	13-Aug-18	15-Sep-18	-34												
FHI-LR1-112C	Road Formation, Road Drainage, TCSS ducting, Profile Barrier and Pavement (CH 80 - CH 240, nr NB66 & 67-1)	70	70	07-Feb-18 A	10-Sep-18	-29												
FHI-LR1-132I	Construction of Mini-piling and Footing of sign gantry DS1 (redesigned to combine with NB)	56	22	25-Jul-17 A	16-Jul-18	19												
FHW-LR1-13	Fabrication and Delivery of Sign Gantry DS1 near AB1	99	34	28-Dec-17 A	30-Jul-18	15												
FHW-LR1-13	Erection of Sign Gantry DS1 near AB1(include On-site Fabrication)	15	15	31-Jul-18	16-Aug-18	15												
<b>Noise Barrier</b>																		
FHI-LR1-10I	Noise Barrier NB67-1 - Remaining ground beam of Bay 3 (allow access from TWSRW)	7	7	31-Jul-18*	07-Aug-18	0												
FHI-LR1-13I	Installation of Steelwork & Panel - NB67-1 (132m)	44	44	07-May-18 A	10-Aug-18	-3												
FHI-LR1-13I	Installation of Steelwork & Panel - NB66 (76m)	12	52	28-Apr-18 A	20-Aug-18	-11												
<b>Link Road 2 (near Abutment AA1)</b>																		
FHI-LR2-202I	Construction of Fill slope FL/F10 and Road Formation of Link Road nr Abutment AA1	78	55	25-Apr-18 A	23-Aug-18	-66												
FHI-LR2-202I	TCSS Duct Laying along Link Road next to FL/F10	52	52	24-Aug-18*	26-Oct-18	-66												
FHI-LR2-203I	Construction of 3SW-D/FR32 Bay 3201 - 3203 (including temporary works)	73	0	24-Feb-18 A	23-Jun-18 A													
FHI-LR2-203I	3SW-D/FR32 Bay 3204 (including temporary works)	48	0	16-Apr-18 A	05-Jul-18 A													
FHI-LR2-203I	3SW-D/FR32 Bay 3205 (including temporary works)	46	0	30-Apr-18 A	25-Jun-18 A													
FHI-LR2-203I	3SW-D/FR32 Bay 3206 (including temporary works)	46	0	26-Apr-18 A	05-Jul-18 A													
FHI-LR2-203I	3SW-D/FR32 Bay 3207 (including temporary works)	43	43	13-Jul-18*	31-Aug-18	-38												
FHI-LR2-203I	3SW-D/FR32 Bay 3208 (including temporary works)	46	46	21-Jul-18*	12-Sep-18	-38												
FHI-LR2-203I	3SW-D/FR32 Bay 3209 (including temporary works)	46	46	30-Jul-18*	20-Sep-18	-38												
FHI-LR2-203I	3SW-D/FR32 Bay 3210 (including temporary works)	45	45	30-Jun-18 A	11-Aug-18	-40												
FHI-LR2-204I	3SW-D/FR32 Bay 3211 (including temporary works)	37	26	21-May-18 A	20-Jul-18	4												
FHI-LR2-204I	3SW-D/FR32 Bay 3212 (including temporary works)	37	37	31-Jul-18*	11-Sep-18	-30												
FHI-LR2-204I	3SW-D/FR32 Bay 3213 (including temporary works)	35	35	06-Aug-18	14-Sep-18	-40												
FHI-LR2-204I	3SW-D/FR32 Bay 3214 (including temporary works)	36	36	13-Aug-18	22-Sep-18	-40												



- █ Actual Work
- █ Remaining Work
- █ Summary Bar
- █ Critical Remaining Work
- ◆ Milestone
- Project Baseline Bar

**CEDD Contract No. CV/2012/09  
Liantang / Heung Yuen Wai BCP - Site Formation & Infrastructure Works, Contract 3**

**3MPR059**

Page 4 of 8

20-Jun-18


3-Month Rolling Programme updated to 2018-6-20


Date	Revision	Checked	Approved



Activity ID	Activity Name	OD	RD	Start	Finish	TF	2018									
							May	Jun	Jul	Aug	Sep	Oct				
FHI-LR2-209	Road Pavement and Drainage next to Abutment (after completion of NB73 Bay 12&13 Stem Wall)	20	20	23-Jul-18	14-Aug-18	-6										
FHI-LR2-209	Road Formation, Road Drainage and Pavement (SMH1302 - 1303 & MY2.4 - 2.5) at grade	72	72	01-Mar-18 A	12-Sep-18	-31										
FHI-LR2-209	Footing of Sign Gantry DS64 (FF1A under VO)	28	0	23-Apr-18 A	17-May-18 A											
FHW-SG-103	Fabrication and Delivery of Sign Gantry DS11	99	26	28-Dec-17 A	20-Jul-18	0										
FHW-SG-103	Erection of Sign Gantry DS11 (include On-site Fabrication)	15	15	21-Jul-18	07-Aug-18	0										
FHW-SG-104	Fabrication and Delivery of Sign Gantry FADS11 and DS64	99	34	02-Feb-18 A	30-Jul-18	-8										
FHW-SG-104	Erection of Sign Gantry FADS11 and DS64 (include On-site Fabrication)	15	15	31-Jul-18	16-Aug-18	-8										
<b>Link Road 3 (near Abutment AD1)</b>																
FHI-LR3-301	Allow Contractor of Contract 4 for Installation of TCSS Cable at Abutment AD1	0	0		29-Mar-18 A											
FHI-LR3-302	Permanent Fill Slope, Construction of Gullies and Profile Barriers	48	48	25-Apr-18 A	15-Aug-18	-37										
FHI-LR3-303	Road Pavement	30	30	16-Aug-18	19-Sep-18	-37										
FHI-LR3-304	Other Civil Works for TCSS duct laying - along Link Road 3	25	25	16-Aug-18	13-Sep-18	-32										
<b>Link Road 4 (near Abutment AC1)</b>																
FHI-LR4-403	Road Formation, Road Drainage, TCSS ducting and Pavement	55	42	27-Nov-17 A	08-Aug-18	-1										
FHI-LR4-404	Remaining Section of Carriageway connect to FLH	44	44	09-Aug-18*	29-Sep-18	15										
<b>Viaduct - Pavement, Street Furnitures, Lighting inside Internal Voids and Others</b>																
RS-1000a	MJ Installation for Pier AD5, AB6, AB12, AD1 and AC5	72	62	15-Mar-18 A	31-Aug-18	-21										
RS-1000b	MJ Installation for AC1, AC11, AA18, AA13 and AA9	33	75	28-May-18 A	15-Sep-18	-34										
RS-1000c	MJ Installation for AA5, AA1, AB1, AD8 and AD14	32	75	16-May-18 A	15-Sep-18	-34										
RS-1010c	Installation of Trunking (Bridge A and D)	60	0	23-Mar-18 A	08-Jun-18 A											
RS-1010d	Installation of Lighting	96	70	09-Mar-18 A	10-Sep-18	-29										
RS-1010e	Cable Connection	31	31	07-Aug-18*	11-Sep-18	-30										
RS-1020a	Allow Access for Street Lighting Installation	132	71	11-Jan-18 A	11-Sep-18	-30										
RS-1020b	Other Street Furniture including Sign Gantry, NB, Handrail, traffic signs, etc, for Bridge A, B, C and D	112	123	26-Feb-18 A	14-Nov-18	-82										
RS-1040b	Watermains Laying at Pier AC4 on Viaduct (under VO171)	45	11	21-May-18 A	03-Jul-18	-13										
RS-1040c	Watermains Laying at Pier AD9 on Viaduct (under VO171)	36	36	24-Jul-18*	03-Sep-18	-23										
RS-1040d	Watermains Laying at Pier AB7 on Viaduct (under VO171)	43	43	16-Jul-18*	03-Sep-18	-23										
RS-1040e	Watermains Laying at Pier AA12 on Viaduct (under VO171)	52	21	21-May-18 A	14-Jul-18	-16										
RS-1040f	Watermains Laying at Pier AA7 on Viaduct (under VO171)	36	36	24-Jul-18*	03-Sep-18	-23										
RS-1040g	Installation of Crash Cushion (Under VO)	101	64	26-Feb-18 A	03-Sep-18	-23										
RS-1070a	Waterproofing on Walk way (AC1-AC9, AB1-AB6, AD1-AD7, AA1-AA18)	14	0	28-May-18 A	12-Jun-18 A											
RS-1070b	Waterproofing AA1 - AA18	30	0	23-Mar-18 A	26-May-18 A											
RS-1070c	Road Pavement AA1 - AA18 (base coarse only)	6	10	28-May-18 A	30-Jun-18	31										
RS-1080a	Waterproofing AB6-AB12 West	18	18	03-Aug-18*	23-Aug-18	-32										

Date	Revision	Checked	Approved

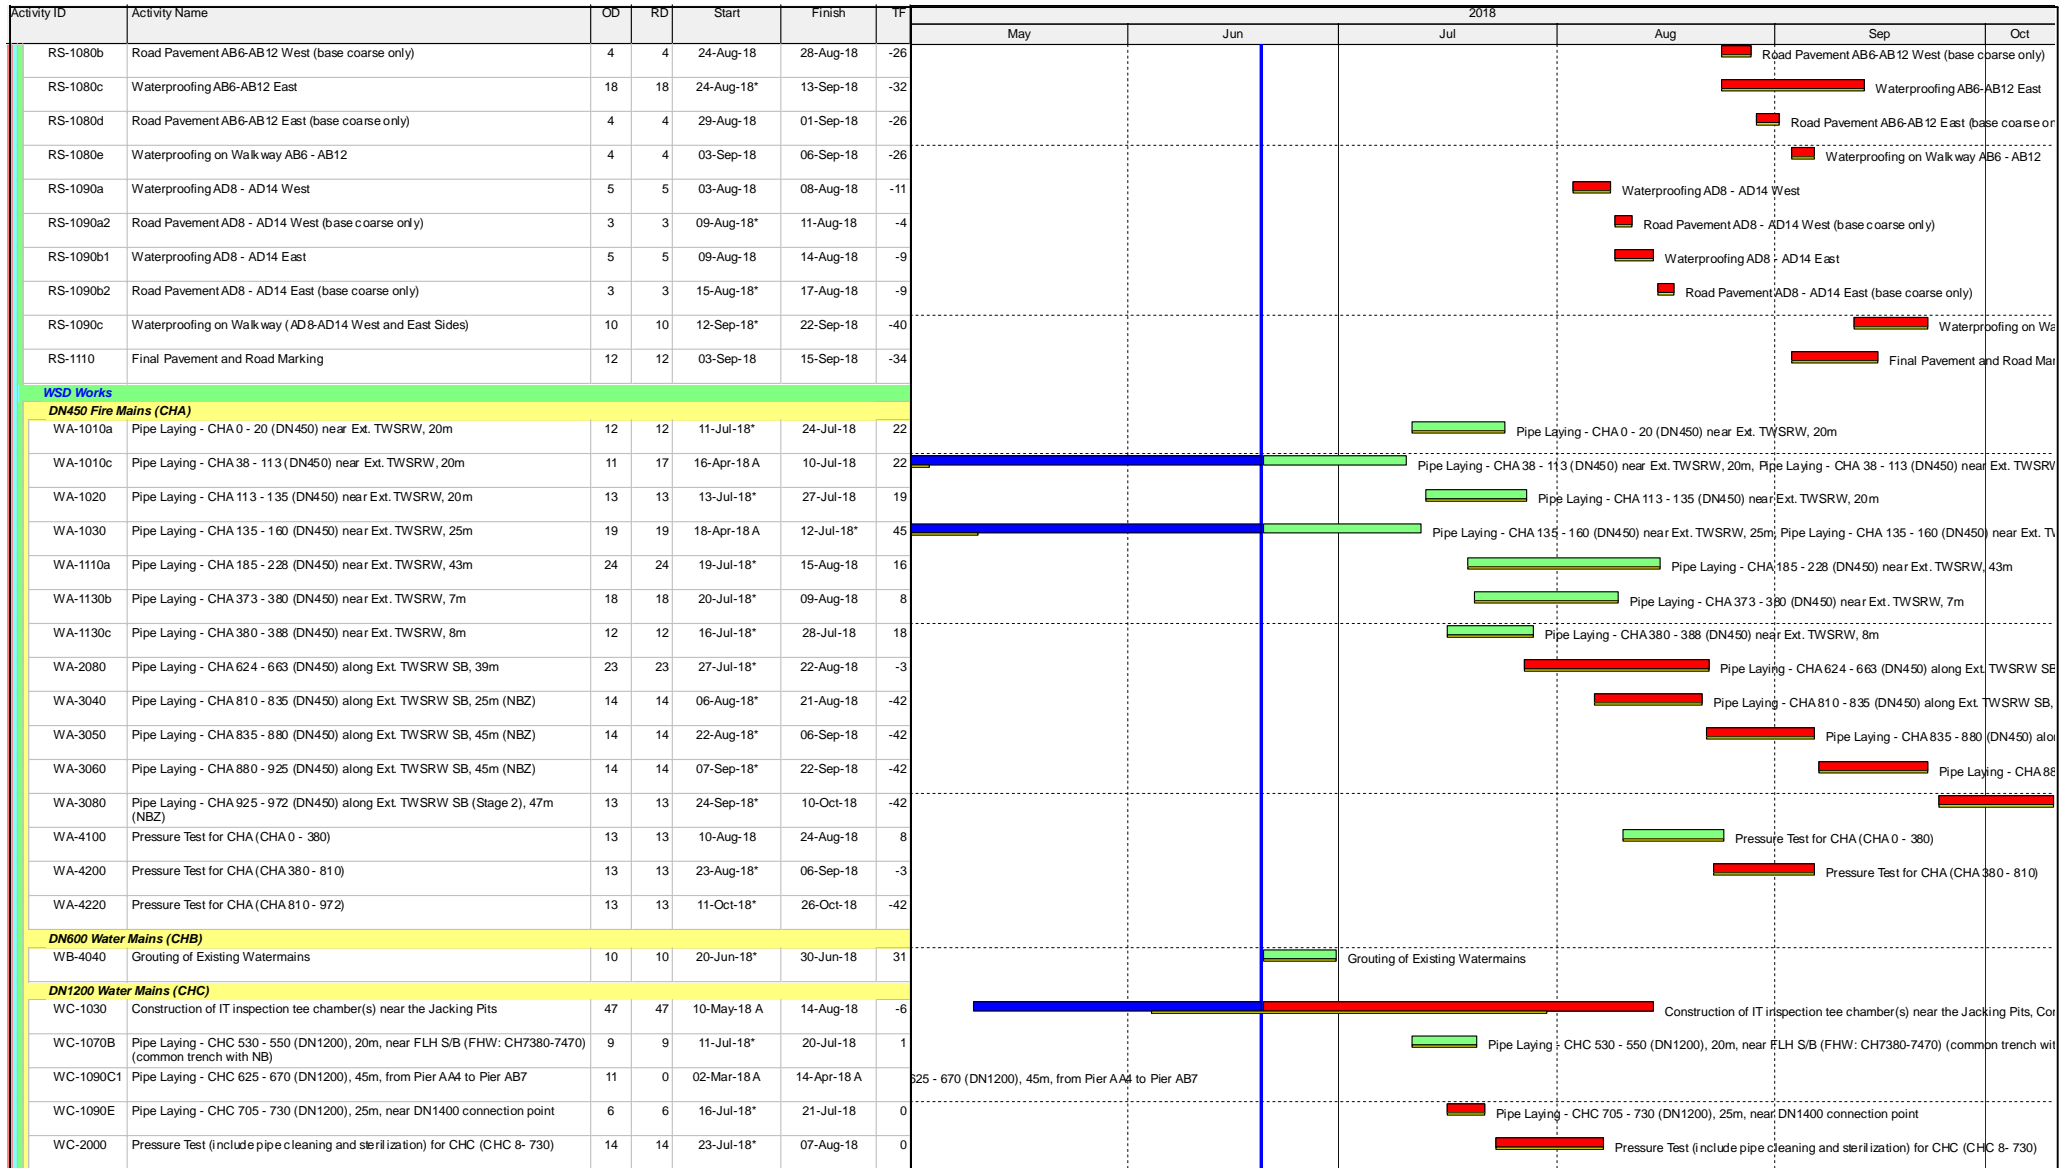

-  Actual Work
-  Remaining Work
-  Summary Bar
-  Critical Remaining Work
-  Milestone
-  Project Baseline Bar


Date	Revision	Checked	Approved





# Appendix B

## Project Organization Structure

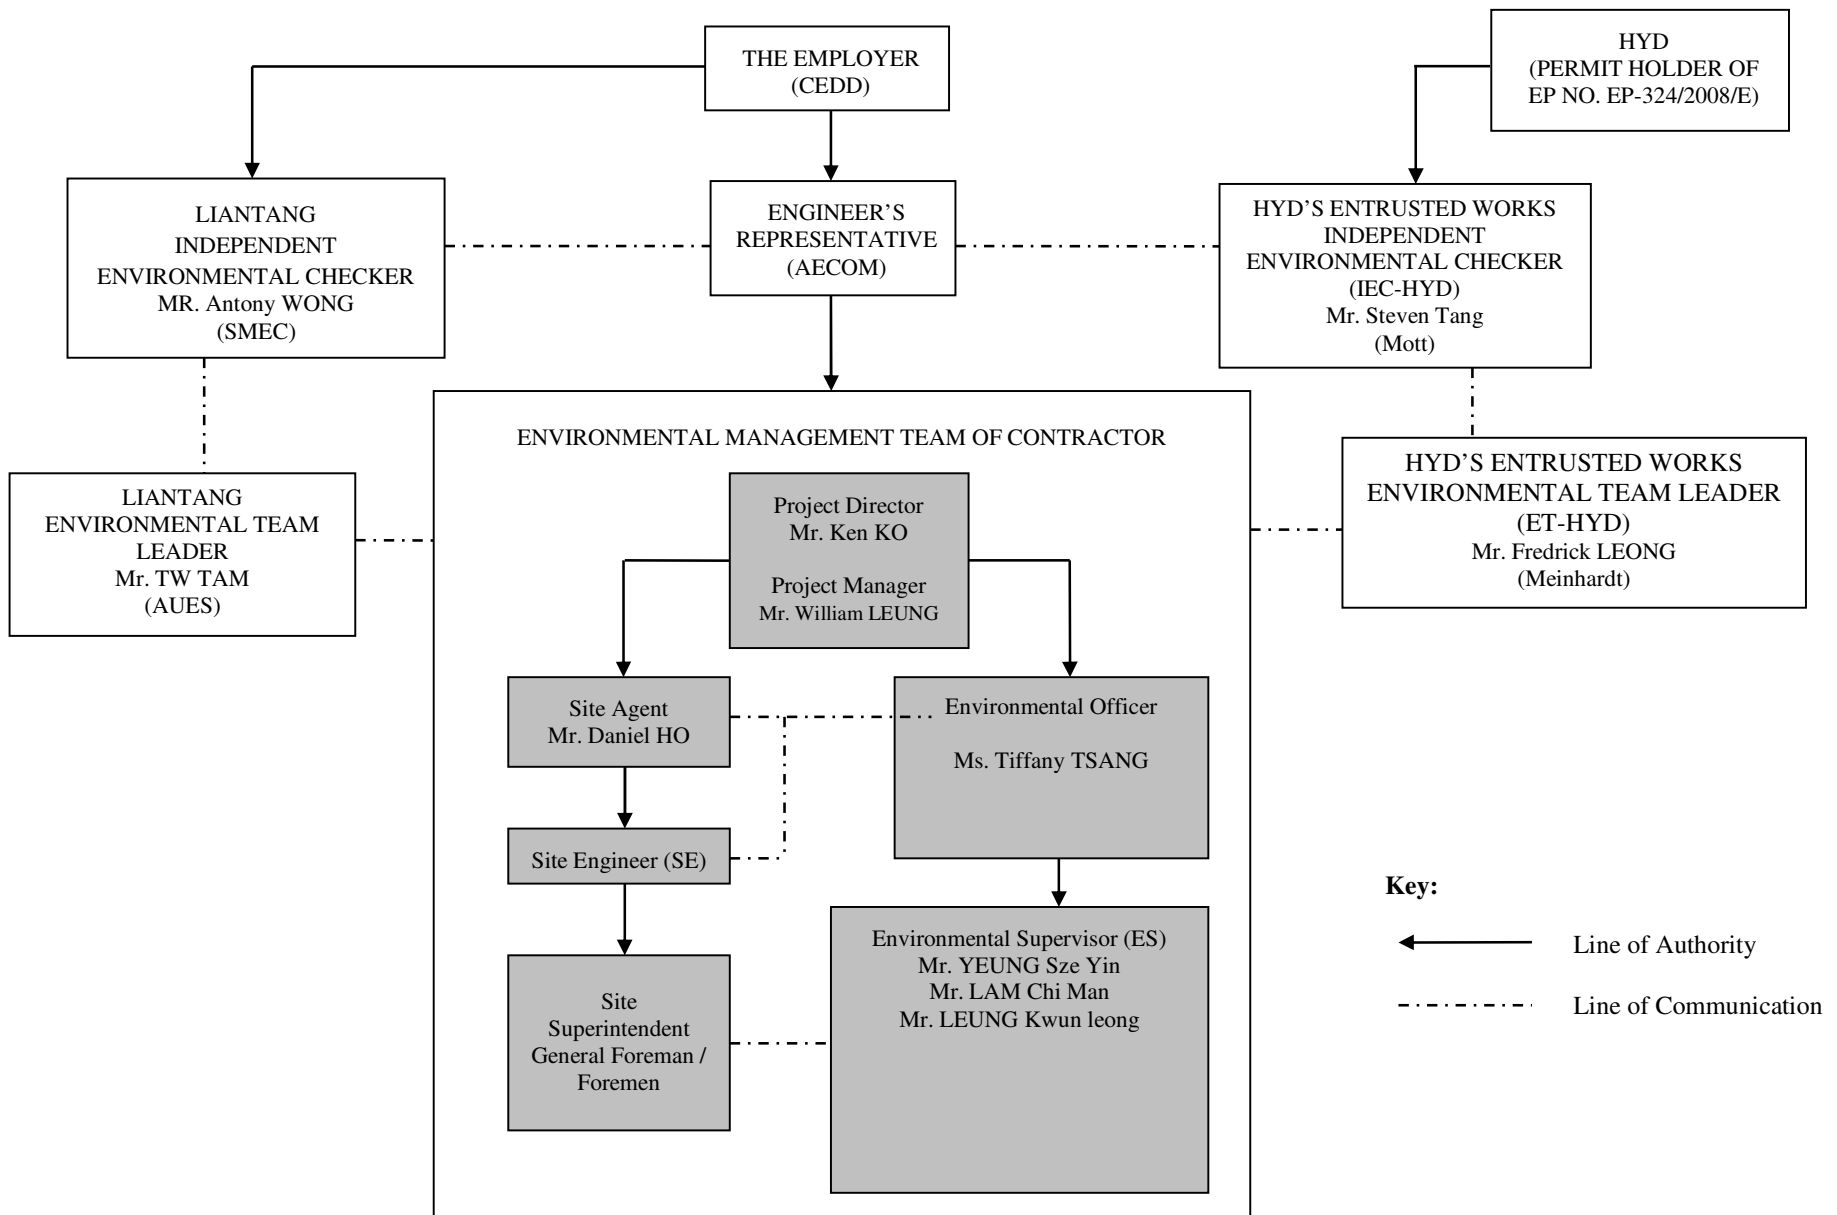

# **Appendix C Calibration Certificates of Monitoring Equipment**



# Certificate of Calibration

Calibration Certification Information			
Cal. Date: February 13, 2018	Rootsmeter S/N: 438320	Ta: 293	°K
Operator: Jim Tisch		Pa: 763.3	mm Hg
Calibration Model #: TE-5025A	Calibrator S/N: <b>1612</b>		

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3970	3.2	2.00
2	3	4	1	1.0000	6.3	4.00
3	5	6	1	0.8900	7.9	5.00
4	7	8	1	0.8440	8.7	5.50
5	9	10	1	0.7010	12.6	8.00

Data Tabulation					
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left( \frac{Ta}{Pa} \right)}$ (y-axis)
1.0172	0.7281	1.4293	0.9958	0.7128	0.8762
1.0130	1.0130	2.0213	0.9917	0.9917	1.2392
1.0109	1.1358	2.2599	0.9896	1.1120	1.3854
1.0098	1.1964	2.3702	0.9886	1.1713	1.4530
1.0046	1.4331	2.8586	0.9835	1.4030	1.7524
<b>QSTD</b>	m=	<b>2.02017</b>	<b>QA</b>	m=	<b>1.26500</b>
	b=	<b>-0.03691</b>		b=	<b>-0.02263</b>
	r=	<b>0.99988</b>		r=	<b>0.99988</b>

Calculations	
Vstd= $\Delta Vol \left( \frac{Pa - \Delta P}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)$	Va= $\Delta Vol \left( \frac{Pa - \Delta P}{Pa} \right)$
Qstd= Vstd/ΔTime	Qa= Va/ΔTime
For subsequent flow rate calculations:	
<b>Qstd=</b> $1/m \left( \left( \sqrt{\Delta H \left( \frac{Pa}{Pstd} \right) \left( \frac{Tstd}{Ta} \right)} \right) - b \right)$	<b>Qa=</b> $1/m \left( \left( \sqrt{\Delta H \left( \frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions	
Tstd:	298.15 °K
Pstd:	760 mm Hg
<b>Key</b>	
ΔH: calibrator manometer reading (in H2O)	
ΔP: rootsmeter manometer reading (mm Hg)	
Ta: actual absolute temperature (°K)	
Pa: actual barometric pressure (mm Hg)	
b: intercept	
m: slope	

RECALIBRATION
US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



### TSP Sampler Calibration

#### SITE

Location: Lian Tang 3                      Date: May 6, 2018  
 Sampler: TE-5170 MFC (Serial # : 2359)      Tech: Sam Wong

#### CONDITIONS

Barometric Pressure (in Hg):	39.85	Corrected Pressure (mm Hg):	1012
Temperature (deg F):	85	Temperature (deg K):	302
Average Press. (in Hg):	39.85	Corrected Average (mm Hg):	1012
Average Temp. (deg F):	85	Average Temp. (deg K):	302

#### CALIBRATION ORIFICE

Make: Tisch                                      Qstd Slope: 2.02017  
 Model: TE-5025A                              Qstd Intercept: -0.03691  
 Serial#: 1612                                      Date Certified: February 13, 2018

#### CALIBRATIONS

Plate or Test #	H2O (in)	Qstd (m3/min)	I (chart)	IC (corrected)	LINEAR REGRESSION
1	12.00	1.983	56.0	64.15	Slope = 31.7376 Intercept = 1.9360 Corr. coeff.= 0.9987 # of Observations: 5
2	10.00	1.811	52.0	59.57	
3	8.20	1.642	48.0	54.99	
4	5.20	1.311	38.0	43.53	
5	3.20	1.033	30.0	34.37	


#### Calculations

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd) (Tstd/Ta)) - b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd) (Tstd/Ta)]$$

Qstd = standard flow rate  
 IC = corrected chart response  
 I = actual chart response  
 m = calibrator Qstd slope  
 b = calibrator Qstd intercept  
 Ta = actual temperature during calibration (deg K)  
 Pa = actual pressure during calibration (mm Hg)  
 Tstd = 298 deg K  
 Pstd = 760 mm Hg  
 For subsequent calculation of sampler flow:  
 $1/m((I) [\text{Sqrt}(298/Tav) (Pav/760)] - b)$

m = sampler slope  
 b = sampler intercept  
 I = chart response  
 Tav = daily average temperature  
 Pav = daily average pressure

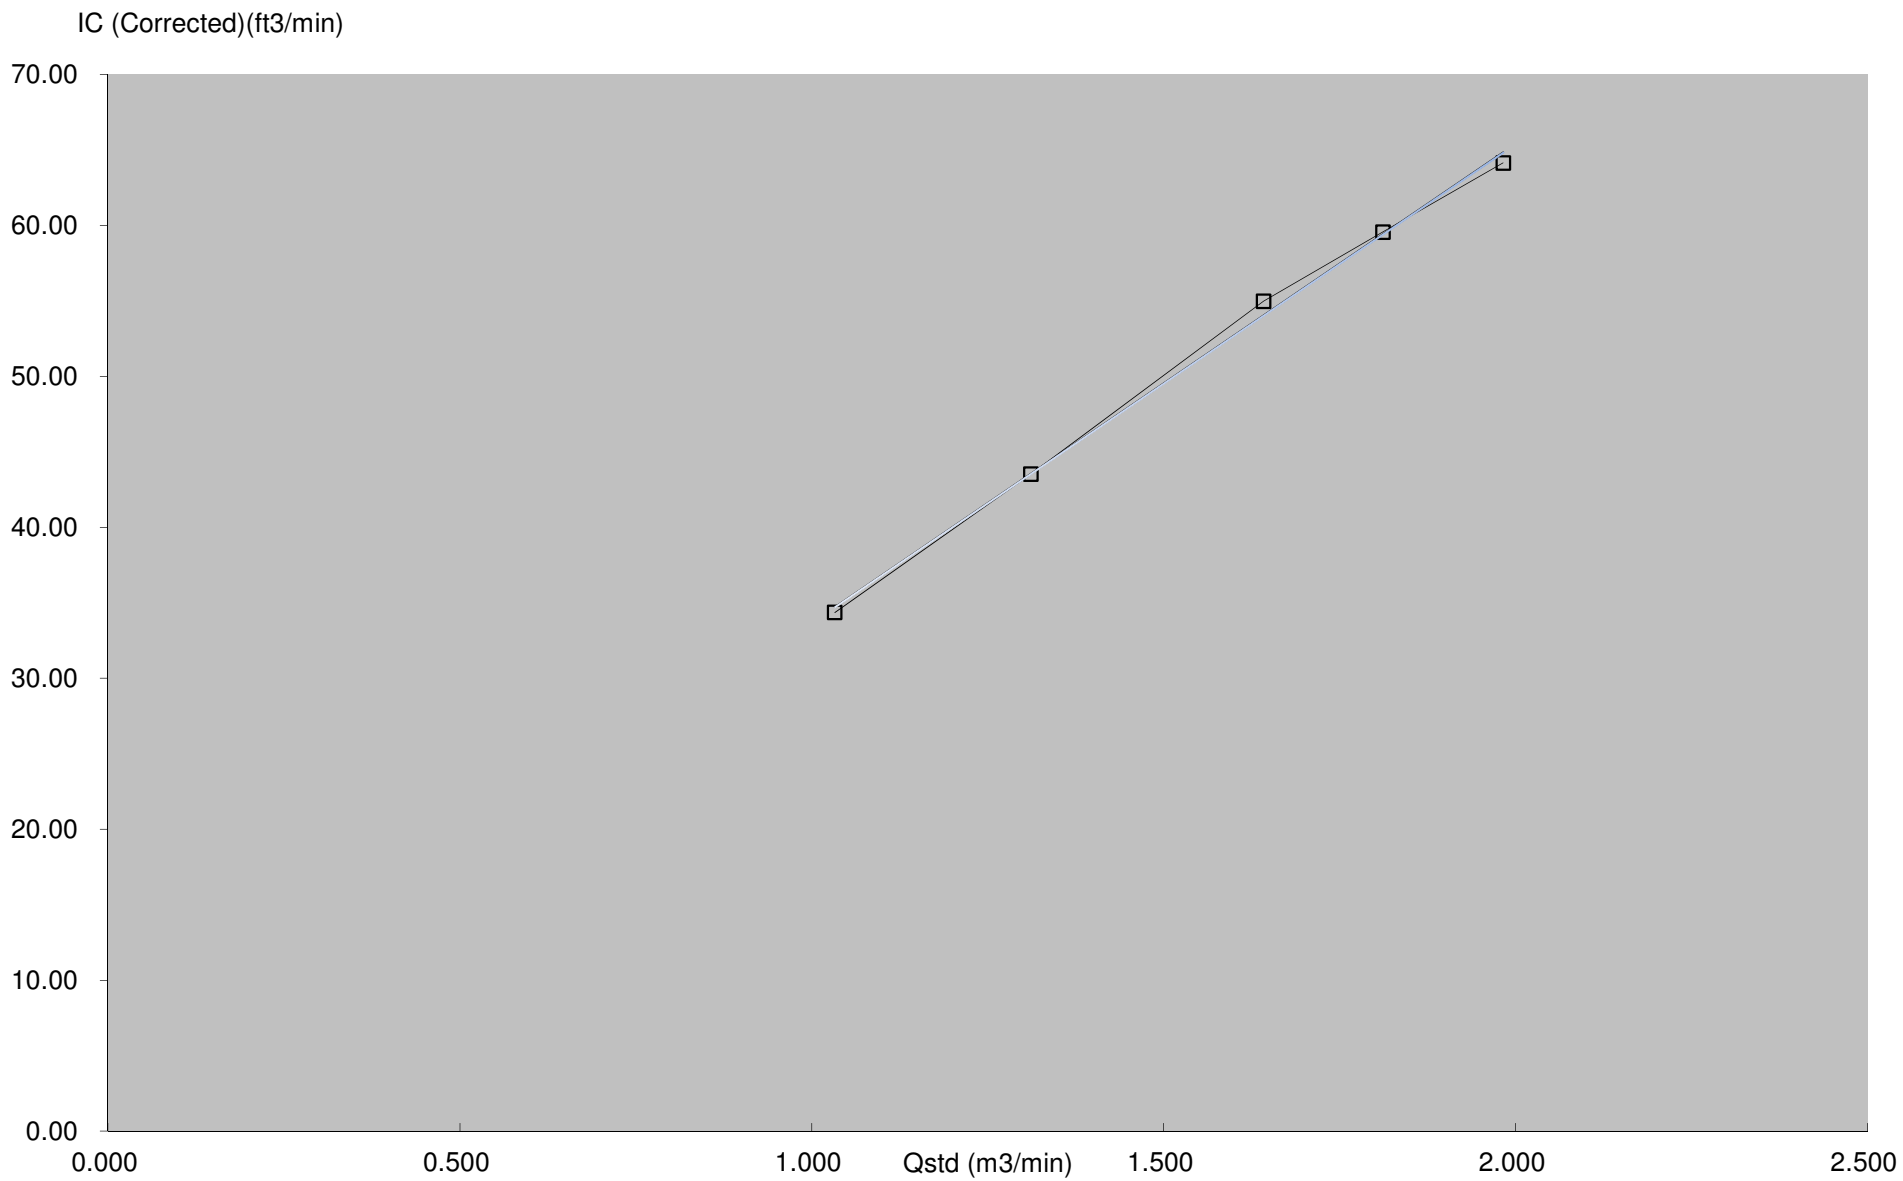



# Calibration Certificate

Certificate No. **708774**

Page 1 of 2 Pages

**Customer :** Enovative Environmental Service Limited

**Address :** Flat 6, 3/F, Block E, Wah Lok Industrial Centre, 31-35 Shan Mei Street, Shatin, N.T., Hong Kong.

**Order No. :** Q73499

**Date of receipt :** 1-Sep-17

## Item Tested

**Description :** Sound Level Calibrator

**Manufacturer :** Rion

**I.D. :** 215901

**Model :** NC-74

**Serial No. :** 34857296

## Test Conditions

**Date of Test :** 4-Sep-17

**Supply Voltage :** --

**Ambient Temperature :** (23 ± 3)°C

**Relative Humidity :** (50 ± 25) %

## Test Specifications

Calibration check.

Ref. Document/Procedure : F21, Z02, IEC 60942.

## Test Results

All results were within the IEC 60942 Class 1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S014	Spectrum Analyzer	707126	NIM-PRC & SCL-HKSAR
S240	Sound Level Calibrator	703741	NIM-PRC & SCL-HKSAR
S041	Universal Counter	707135	SCL-HKSAR
S206	Sound Level Meter	707129	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant.

The test results apply to the above Unit-Under-Test only

**Calibrated by :** \_\_\_\_\_  
Elva Chong

**Approved by :** \_\_\_\_\_  
Alan Chu

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646

**Date:** 4-Sep-17

# Calibration Certificate

Certificate No. 708774

Page 2 of 2 Pages

Results :

## 1. Level Accuracy (at 1 kHz)

UUT Nominal Value	Measured Value	Mfr's Spec.
94 dB	94.1 dB	$\pm 1$ dB

Uncertainty :  $\pm 0.2$  dB

## 2. Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Spec.
1 kHz	0.998 kHz	$\pm 2$ %

Uncertainty :  $\pm 0.1$  %

## 3. Level Stability : 0.0 dB

Uncertainty :  $\pm 0.01$  dB

## 4. Total Harmonic Distortion : $< 1.5\%$

Mfr's Spec. :  $< 3$  %

Uncertainty :  $\pm 2.3$  % of reading

Remarks: 1. UUT : Unit-Under-Test  
2. The uncertainty claimed is for a confidence probability of not less than 95%.  
3. Atmospheric Pressure : 1 025 hPa

----- END -----

# Calibration Certificate

Certificate No. **708773**

Page 1 of 3 Pages

**Customer :** Enovative Environmental Service Limited

**Address :** Flat 6, 3/F, Block E, Wah Lok Industrial Centre, 31-35 Shan Mei Street, Shatin, N.T., Hong Kong.

**Order No. :** Q73499

**Date of receipt :** 1-Sep-17

## Item Tested

**Description :** Sound Level Meter

**Manufacturer :** Rion

**I.D. :** --

**Model :** NL-52

**Serial No. :** 00821072

## Test Conditions

**Date of Test :** 5-Sep-17

**Supply Voltage :** --

**Ambient Temperature :**  $(23 \pm 3)^{\circ}\text{C}$

**Relative Humidity :**  $(50 \pm 25) \%$

## Test Specifications

Calibration check.

Ref. Document/Procedure: Z01, IEC 61672.

## Test Results

All results were within the IEC 61672 Type1 or manufacturer's specification.

The results are shown in the attached page(s).

Main Test equipment used:

<u>Equipment No.</u>	<u>Description</u>	<u>Cert. No.</u>	<u>Traceable to</u>
S017	Multi-Function Generator	C170120	SCL-HKSAR
S240	Sound Level Calibrator	703741	NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant.  
The test results apply to the above Unit-Under-Test only

**Calibrated by :** \_\_\_\_\_  
Elva Chong

**Approved by :** \_\_\_\_\_  
Alan Chu

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646

**Date:** 5-Sep-17

# Calibration Certificate

Certificate No. 708773

Page 2 of 3 Pages

Results :

1. Self-generated noise: 16.4 dBA (Mfr's Spec  $\leq$  17 dBA )

## 2. Acoustical signal test

UUT Setting				Applied Value (dB)	UUT Reading (dB)	
Range (dB)	Frequency Weighting	Time Weighting	Octave Filter			
20-130	A	F	OFF	94.0	94.1	
		S	OFF		94.1	
	C	F	OFF		94.1	
	Z	F	OFF		94.1	
	A	F	OFF	114.0	114.1	
			OFF		114.1	
		C	F		OFF	114.1
			F		OFF	114.1

IEC 61672 Type 1 Spec. :  $\pm$  1.1 dB

Uncertainty :  $\pm$  0.1 dB

## 3 Electrical signal tests of frequency weightings (A weighting)

Frequency	Attenuation (dB)	IEC 61672 Type 1 Spec.
31.5 Hz	-39.7	- 39.4 dB, $\pm$ 2 dB
63 Hz	-26.2	- 26.2 dB, $\pm$ 1.5 dB
125 Hz	-16.2	- 16.1 dB, $\pm$ 1.5 dB
250 Hz	-8.7	- 8.6 dB, $\pm$ 1 dB
500 Hz	-3.2	- 3.2 dB, $\pm$ 1.4 dB
1 kHz	0.0 (Ref)	0 dB, $\pm$ 1.1 dB
2 kHz	+1.2	+ 1.2 dB, $\pm$ 1.6 dB
4 kHz	+1.0	+ 1.0 dB, $\pm$ 1.6 dB
8 kHz	-1.1	- 1.1 dB, + 2.1 dB $\sim$ -3.1 dB
16 kHz	-8.0	- 6.6 dB, + 3.5 dB $\sim$ - 17.0 dB

Uncertainty :  $\pm$  0.1 dB

# Calibration Certificate

Certificate No. 708773

Page 3 of 3 Pages

## 4. Frequency & Time weightings at 1 kHz

### 4.1 Frequency Weighting (Fast)

UUT Setting	Applied Value (dB)	UUT Reading (dB)	Difference (dB)	IEC 61672 Type 1 Spec.
A	94.0	94.0 (Ref.)	--	± 0.4 dB
C	94.0	94.0	0.0	
Z	94.0	94.0	0.0	

### 4.2 Time Weighting (A-weighted)

UUT Setting	Applied Value (dB)	UUT Reading (dB)	Difference (dB)	IEC 61672 Type 1 Spec.
Fast	94.0	94.0 (Ref.)	--	± 0.3 dB
Slow	94.0	94.0	0.0	
Time-averaging	94.0	94.0	0.0	

Uncertainty : ± 0.1 dB

Remarks : 1. UUT : Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure : 1 028hPa.

4. Preamplifier model : NH-25 , S/N : 10553

5. Microphone model: UC-59 , S/N : 07040

6. Power Supply Check: OK

7. The UUT was adjusted with the supplied sound calibrator at the reference sound pressure level before the calibration.

----- END -----

# Appendix D

## EM&A Monitoring Schedules



**Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2  
Impact Monitoring & Site Auditing Schedule for June 2018**

June 2018						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
					1	2
3	4	5 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	6	7 ET Site Walk(09:30am – 11:00am)	8	9
10	11 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	12	13	14 ET Site Walk(09:30am – 11:00am)	15 24-hour TSP + 3 x 1-hour TSP	16
17	18 Tuen Ng Festival	19	20 ET Site Walk(09:30 am – 11:00 am) with Liantang Project-wide ET and IEC + SSEMC	21 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	22	23
24	25	26	27 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	28 ET Site Walk(09:30am – 11:00 am) with Fanling Stage 2 IEC & Liantang Project-wide ET and IEC	29	30

**Entrusted Portion of Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling Stage 2  
Impact Monitoring & Site Auditing Schedule for July 2018**

July 2018						
Sun	Mon	Tue	Wed	Thu	Fri	Sat
<b>1</b>	<b>2</b> Hong Kong Special Administrative Region Establishment Day observed	<b>3</b> 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	<b>4</b>	<b>5</b> ET Site Walk(09:30am – 11:00am)	<b>6</b>	<b>7</b>
<b>8</b>	<b>9</b> 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	<b>10</b>	<b>11</b>	<b>12</b> ET Site Walk(09:30am – 11:00am)	<b>13</b> 24-hour TSP + 3 x 1-hour TSP	<b>14</b>
<b>15</b>	<b>16</b>	<b>17</b>	<b>18</b> ET Site Walk(09:30 am – 11:00 am) with Liantang Project-wide ET and IEC + SSEMC (To be confirmed)	<b>19</b> 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	<b>20</b>	<b>21</b>
<b>22</b>	<b>23</b>	<b>24</b>	<b>25</b> 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)	<b>26</b> ET Site Walk(09:30am – 11:00 am) with Fanling Stage 2 IEC & Liantang Project-wide ET and IEC (To be confirmed)	<b>27</b>	<b>28</b>
<b>29</b>	<b>30</b>	<b>31</b> 24-hour TSP + 3 x 1-hour TSP, Noise (SR77)				

# **Appendix E**

## **Meteorological Data Extracted from Hong Kong Observatory**

**Daily Extract of Meteorological Observations , June 2018**

Day	Hong Kong Observatory							
	Mean Pressure (hPa)	Air Temperature			Mean Dew Point (deg. C)	Mean Relative Humidity (%)	Mean Amount of Cloud (%)	Total Rainfall (mm)
		Absolute Daily Max (deg. C)	Mean (deg. C)	Absolute Daily Min (deg. C)				
01	1009.9	35.1	30.2	27.8	25.1	75	74	0.0
02	1010.5	32.8	29.1	27.2	23.8	74	73	Trace
03	1008.4	32.6	29.3	27.3	24.1	74	78	Trace
04	1007.4	31.2	28.0	26.5	25.1	85	85	12.4
05	1006.8	29.5	27.1	25.9	25.7	92	88	28.2
06	1005.0	28.4	27.2	26.0	26.0	93	96	58.3
07	1004.3	28.6	27.3	26.0	25.9	92	92	47.4
08	1001.0	30.2	27.8	25.3	25.6	88	93	70.2
09	999.1	30.4	28.6	26.5	24.4	79	86	4.8
10	1000.4	33.4	30.0	27.4	23.6	69	69	0.0
11	1002.4	34.3	30.5	28.0	21.4	59	54	0.0
12	1002.4	30.1	27.5	25.2	25.2	88	89	39.6
13	998.2	28.5	26.6	25.6	25.5	94	94	109.3
14	998.3	28.6	26.8	25.4	23.5	82	89	1.3
15	1001.8	29.1	27.1	25.7	22.6	76	86	0.2
16	1003.6	31.5	28.4	26.9	22.3	70	66	0.0
17	1002.3	30.8	28.3	26.2	22.8	72	60	Trace
18	1002.0	31.9	28.9	27.4	24.5	77	82	Trace
19	1004.1	31.5	29.6	28.6	25.5	79	85	Trace
20	1005.5	32.4	30.2	28.8	26.0	78	87	Trace
21	1005.9	31.6	30.0	28.7	26.2	81	85	2.6
22	1006.2	30.4	27.8	25.4	25.3	87	87	32.9
23	1006.7	29.7	27.0	24.4	25.2	90	89	25.6
24	1008.2	32.5	28.7	26.4	25.6	84	84	18.1
25	1008.9	31.3	28.1	26.0	25.3	85	83	6.2
26	1010.6	33.4	29.2	25.9	25.2	80	61	1.7
27	1010.0	31.9	29.2	27.4	25.0	78	63	Trace
28	1007.0	32.6	29.7	27.7	24.7	75	38	0.0
Mean/Total	1004.9	31.2	28.5	26.6	24.7	81	79	458.8
Normal <sup>§</sup>	1006.1	30.2	27.9	26.2	24.6	82	77	456.1

# **Appendix F**

## **Air Quality Monitoring Results and their Graphical Presentation**


Appendix F  
Air Quality Monitoring Results and their Graphical Presentation

24-Hour TSP Monitoring Result at Station: SR77


Sampling Date	Weather Condition	Starting Time	Paper No.	Wt. of paper (g)			Elapse Time			Flow Rate (CFM)			Flow Rate (m <sup>3</sup> /min)			Total Volume (m <sup>3</sup> )	TSP Concentration (µg/m <sup>3</sup> )	Action Level (µg/m <sup>3</sup> )	Limit Level (µg/m <sup>3</sup> )	Wind speed m/s	Wind direction	NOE	IR
				Initial Wt.	Final Wt.	Wt. of Dust	Initial	Final	Sampling Hour	Initial	Final	Avg Flow Rate	Initial	Final	Avg Flow Rate								
5-Jun-18	Rainy	12:11	C138	2.8060	2.8453	0.0393	8388.67	8412.67	24.00	51	51	51.0	1.44	1.44	1.44	2079.59	18.9	170.3	260.0	<5	N		
11-Jun-18	Sunny	12:10	C140	2.8223	2.9598	0.1375	8415.67	8439.67	24.00	51	51	51.0	1.44	1.44	1.44	2079.59	66.1	170.3	260.0	<5	N		
15-Jun-18	Fine	12:12	C142	2.8141	2.9231	0.1090	8442.67	8466.67	24.00	51	51	51.0	1.44	1.44	1.44	2079.59	52.4	170.3	260.0	<5	N		
21-Jun-18	Fine	12:11	C144	2.8217	2.9092	0.0875	8469.67	8493.67	24.00	51	51	51.0	1.44	1.44	1.44	2079.59	42.1	170.3	260.0	<5	N		
27-Jun-18	Fine	12:12	C146	2.8174	2.9411	0.1237	8496.67	8520.67	24.00	51	51	51.0	1.44	1.44	1.44	2079.59	59.5	170.3	260.0	<5	N		
																<b>Average</b>	47.8						
																<b>Min</b>	18.9						
																<b>Max</b>	66.1						

Note: No major dust source observed during the monitoring period  
 Data in **Bold** denotes exceedance of respective Action Level  
 Data in **Bold Underline** denotes exceedance of respective Limit Level

### 24-Hour TSP Monitoring Result at Station: SR77

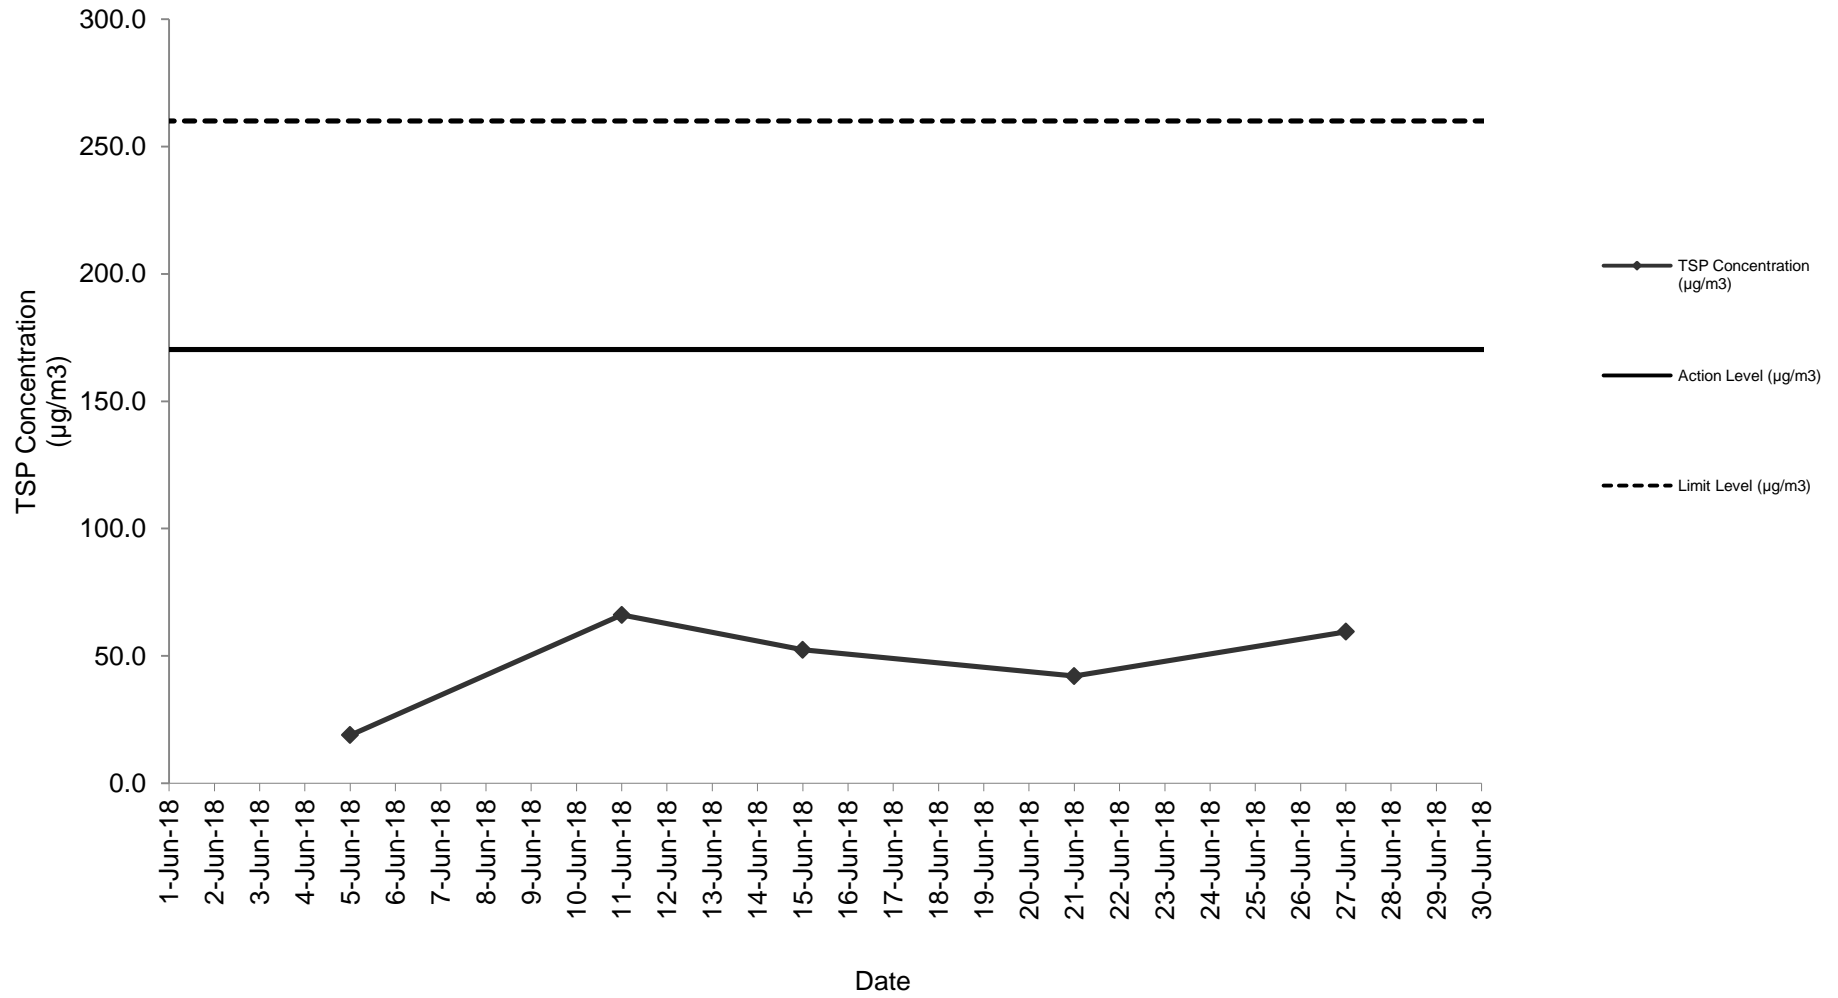

### 24-Hour TSP Monitoring Result at Station: SR77 (March 2018 - June 2018)

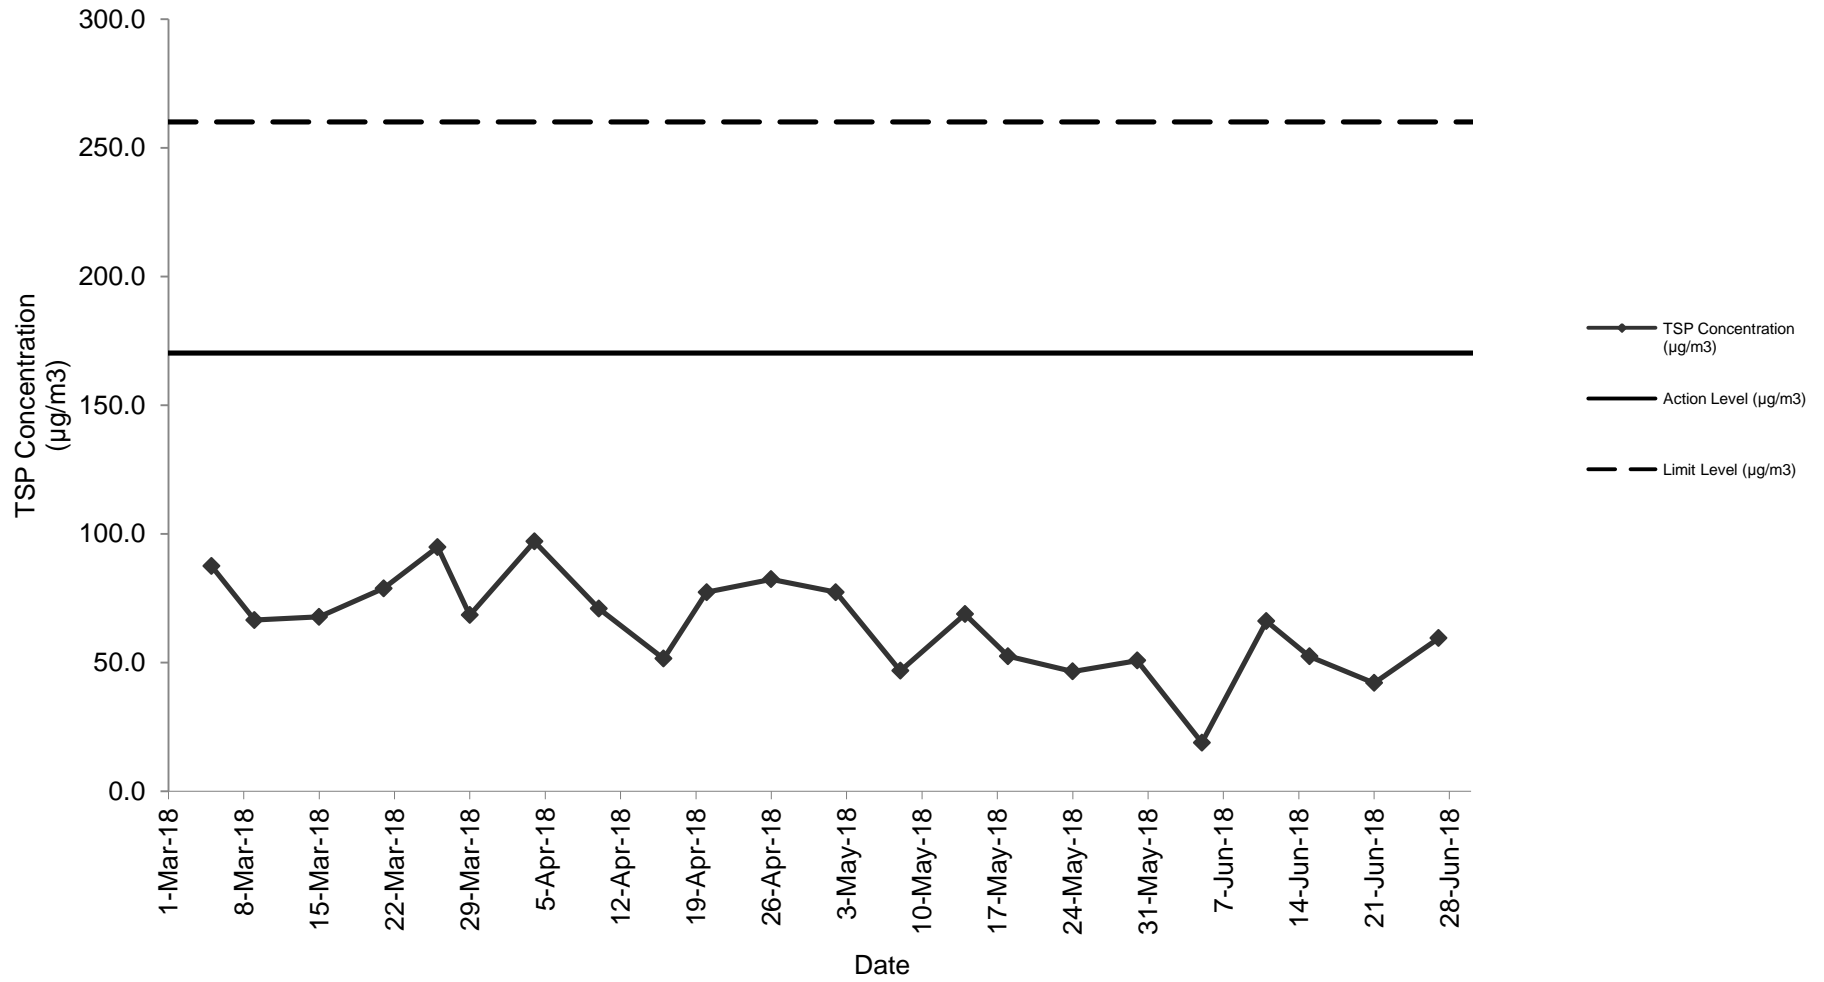




Appendix F  
Air Quality Monitoring Results and their Graphical Presentation

Detailed Calculation of 1-Hour TSP Monitoring Result at Station: SR77


Sampling Date	Weather Condition	Starting Time	Paper No.	Wt. of paper (g)			Elapse Time			Flow Rate (CFM)			Flow Rate (m <sup>3</sup> /min)			Total Volume (m <sup>3</sup> )	TSP Concentration (µg/m <sup>3</sup> )	Action Level (µg/m <sup>3</sup> )	Limit Level (µg/m <sup>3</sup> )	Wind speed m/s	Wind direction	NOE	IR
				Initial Wt.	Final Wt.	Wt. of Dust	Initial	Final	Sampling Hour	Initial	Final	Avg Flow Rate	Initial	Final	Avg Flow Rate								
5-Jun-18	Rainy	09:00	C139A	2.8230	2.8356	0.0126	8385.67	8386.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	145.4	292.7	500.0	<5	N		
	Rainy	10:04	C139B	2.8186	2.8314	0.0128	8386.67	8387.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	147.7	292.7	500.0	<5	N		
	Rainy	11:08	C139C	2.8198	2.8329	0.0131	8387.67	8388.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	151.2	292.7	500.0	<5	N		
11-Jun-18	Sunny	09:00	C141A	2.8214	2.8304	0.0090	8412.67	8413.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	103.9	292.7	500.0	<5	N		
	Sunny	10:03	C141B	2.8171	2.8265	0.0094	8413.67	8414.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	108.5	292.7	500.0	<5	N		
	Sunny	11:09	C141C	2.8083	2.8176	0.0093	8414.67	8415.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	107.3	292.7	500.0	<5	N		
15-Jun-18	Fine	09:00	C143A	2.8182	2.8277	0.0095	8439.67	8440.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	109.6	292.7	500.0	<5	N		
	Fine	10:04	C143B	2.8108	2.8204	0.0096	8440.67	8441.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	111.1	292.7	500.0	<5	N		
	Fine	11:08	C143C	2.8049	2.8149	0.0100	8441.67	8442.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	115.4	292.7	500.0	<5	N		
21-Jun-18	Fine	09:00	C145A	2.8206	2.8294	0.0088	8466.67	8467.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	101.6	292.7	500.0	<5	N		
	Fine	10:03	C145B	2.8171	2.8254	0.0083	8467.67	8468.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	95.8	292.7	500.0	<5	N		
	Fine	11:08	C145C	2.8159	2.8244	0.0085	8468.67	8469.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	98.1	292.7	500.0	<5	N		
27-Jun-18	Fine	09:00	C147A	2.8114	2.8211	0.0097	8493.67	8494.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	111.9	292.7	500.0	<5	N		
	Fine	10:04	C147B	2.8089	2.8189	0.0100	8494.67	8495.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	115.4	292.7	500.0	<5	N		
	Fine	11:08	C147C	2.8067	2.8163	0.0096	8495.67	8496.67	1.00	51	51	51.0	1.44	1.44	1.44	86.65	110.8	292.7	500.0	<5	N		
																<b>Average</b>	115.6						
																<b>Min</b>	95.8						
																<b>Max</b>	151.2						

Note: No major dust source observed during the monitoring period  
Data in **Bold** denotes exceedance of respective Action Level  
Data in **Bold Underline** denotes exceedance of respective Limit Level

### 1-Hour TSP Monitoring Result at station: SR77

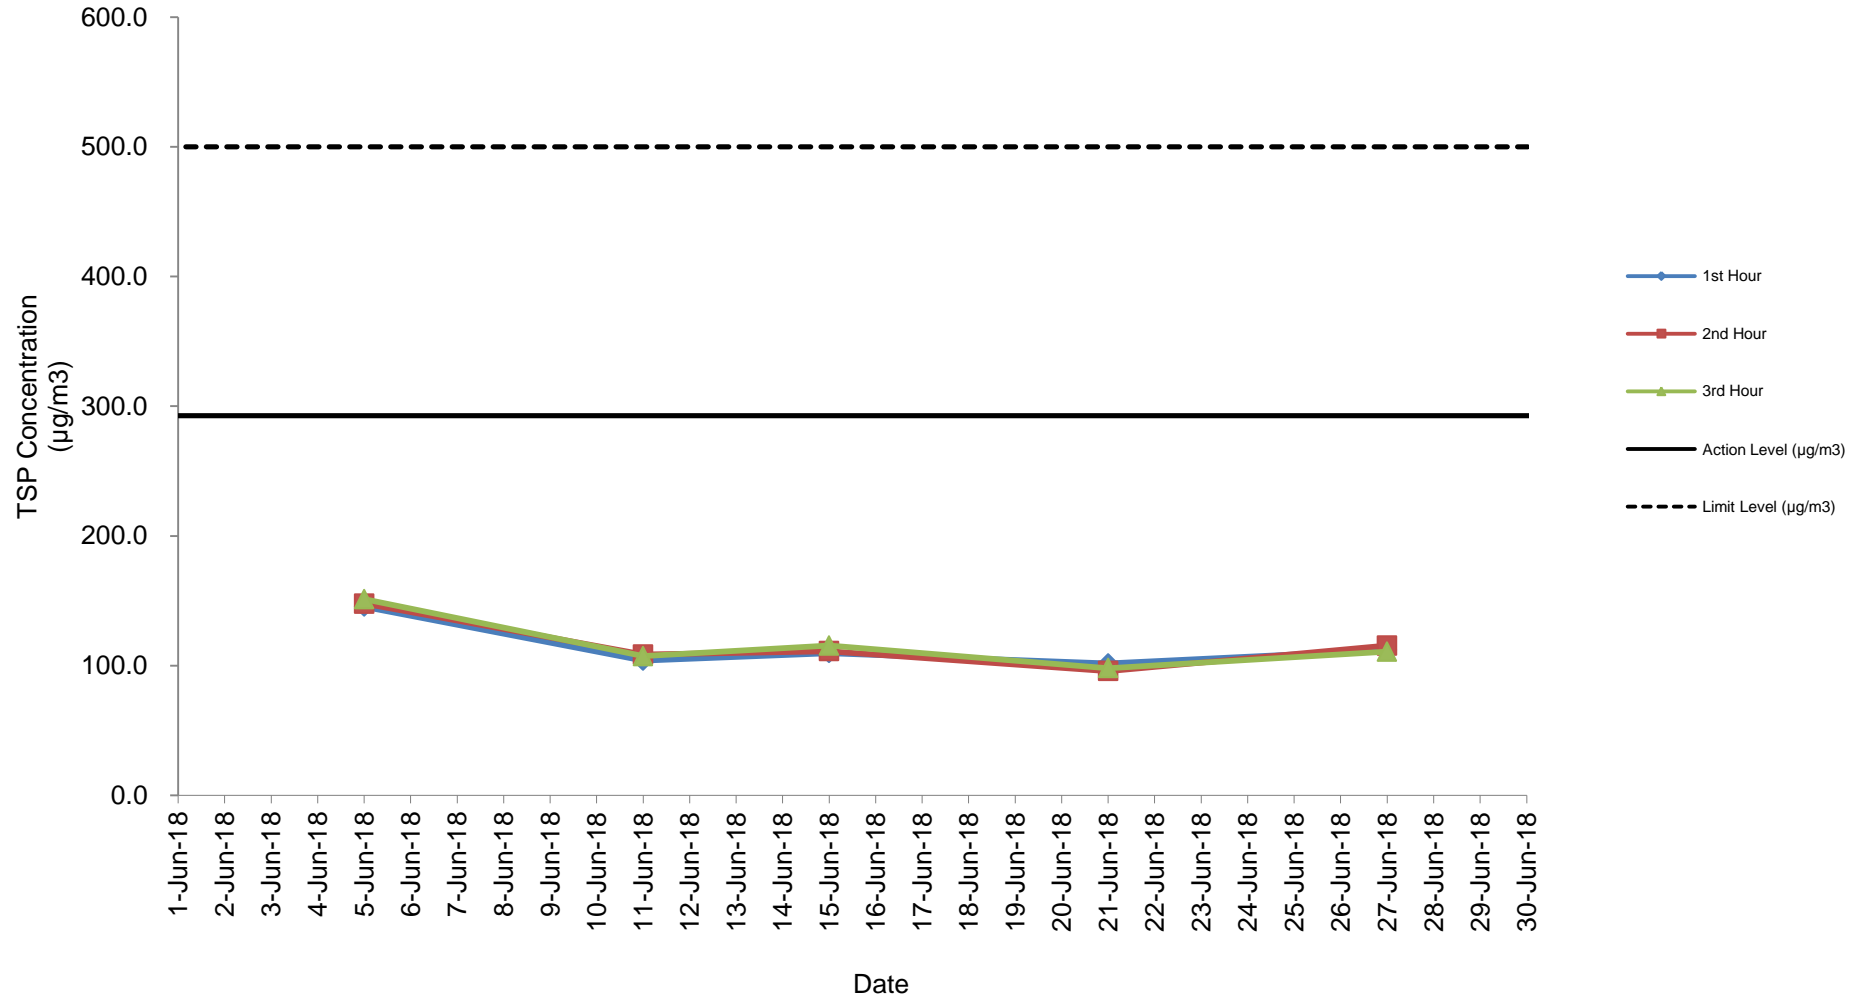

### 1-Hour TSP Monitoring Result at station: SR77 (March 2018 - June 2018)

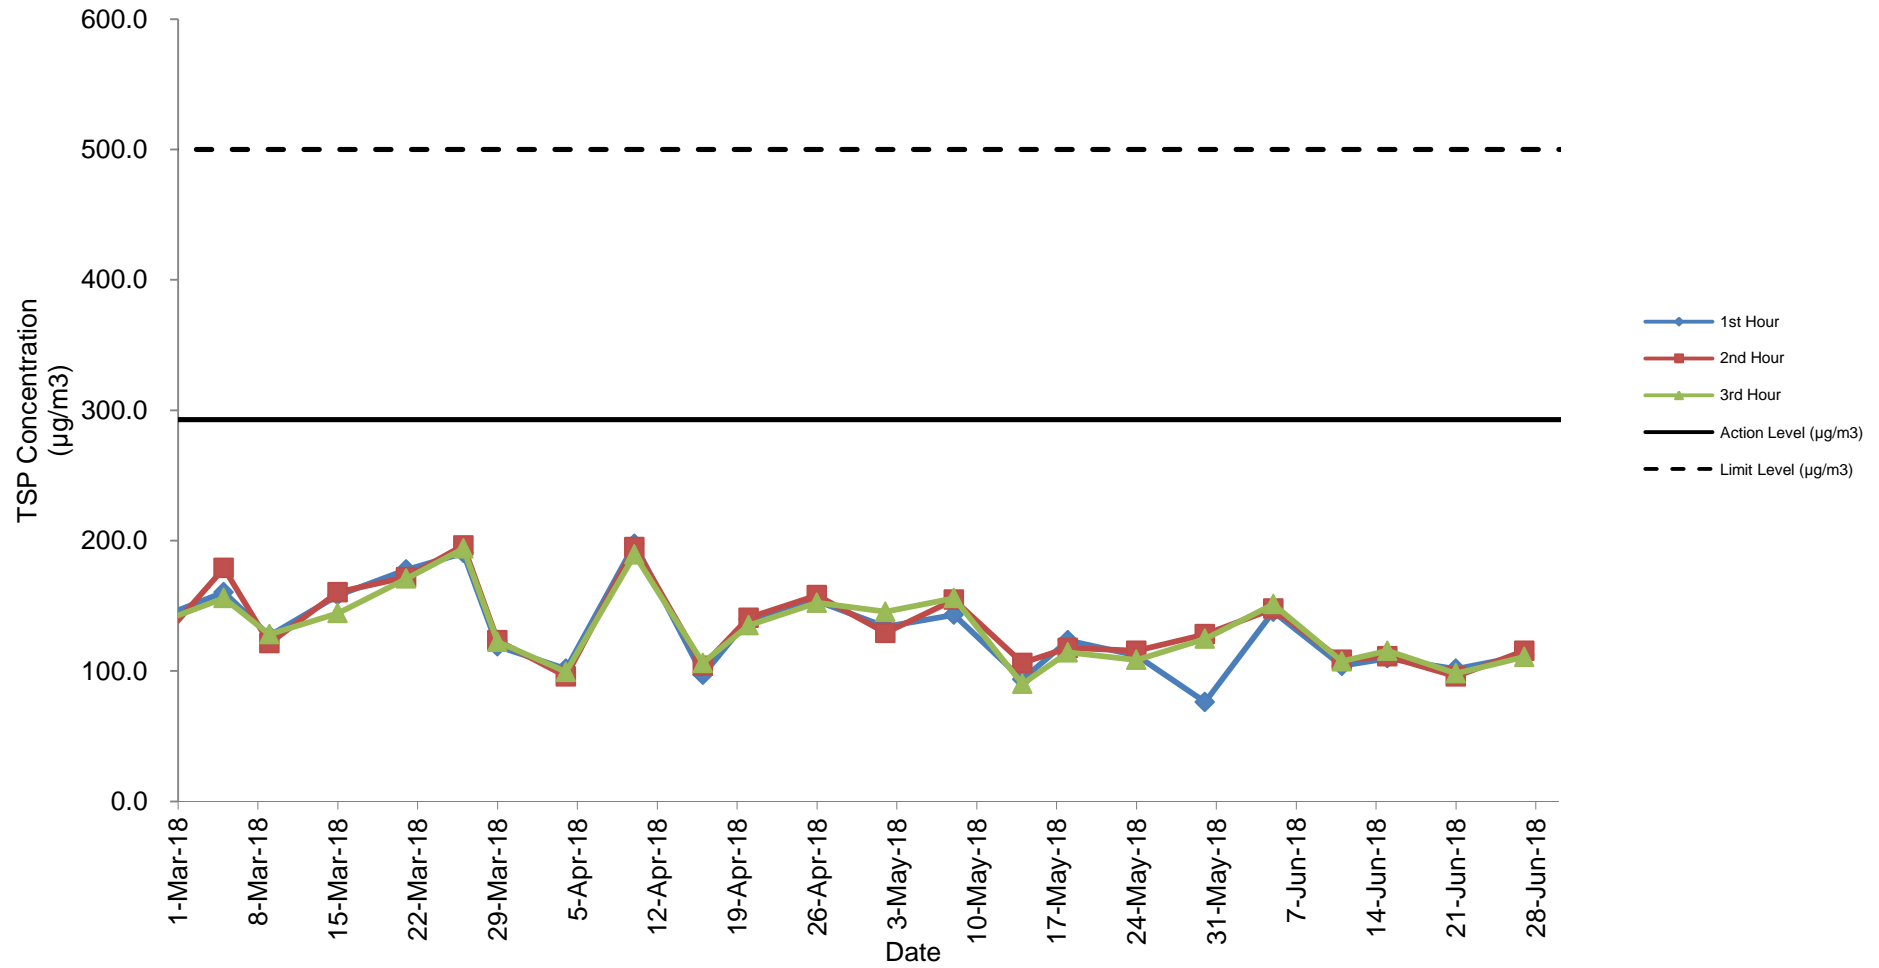

# Appendix G

## Summary of Event and Action Plan

**Event and Action Plan for Air Quality**

Event	Action			
	ET Leader	IEC	ER	Contractor
Action level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Identify source;</li> <li>2. Inform IEC and ER;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET;</li> <li>2. Check Contractor's working method.</li> </ol>	<ol style="list-style-type: none"> <li>1. Notify Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>1. Rectify any unacceptable practice;</li> <li>2. Amend working methods if appropriate.</li> </ol>
Action level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> <li>1. Identify source;</li> <li>2. Inform IEC and ER;</li> <li>3. Repeat measurements to confirm findings;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Discuss with IEC and Contractor on remedial actions required;</li> <li>6. If exceedance continues, arrange meeting with IEC and ER;</li> <li>7. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET;</li> <li>2. Check Contractor's working method;</li> <li>3. Discuss with ET and Contractor on possible remedial measures;</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>5. Supervise Implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>2. Implement the agreed proposals;</li> <li>3. Amend proposal if appropriate.</li> </ol>

Event	Action			
	ET Leader	IEC	ER	Contractor
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Identify source;</li> <li>2. Inform IEC, ER, Contractor and EPD;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET;</li> <li>2. Check Contractor's working method;</li> <li>3. Discuss with ET and Contractor on possible remedial measures;</li> <li>4. Advise ER on the effectiveness of the proposed remedial measures;</li> <li>5. Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of exceedance in writing;</li> <li>2. Notify Contractor;</li> <li>3. Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>3. Implement the agreed proposals;</li> <li>4. Amend proposal if appropriate.</li> </ol>
Limit level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> <li>1. Notify IEC, ER, Contractor, and EPD;</li> <li>2. Identify source;</li> <li>3. Repeat measurement to confirm findings;</li> <li>4. Increase frequency to daily;</li> <li>5. Analyse Contractor's working procedures to determine possible mitigation to be;</li> <li>6. Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of exceedance in writing;</li> <li>2. Notify Contractor;</li> <li>3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>3. Implement the agreed proposals;</li> <li>4. Resubmit proposals if problem still not under control;</li> <li>5. Stop the relevant portion of works as determined by ER until the exceedance is abated.</li> </ol>

**Event and Action Plan for Noise**

Event	Action			
	ET Leader	IEC	ER	Contractor
Action Level	<ol style="list-style-type: none"> <li>1. Notify IEC and the Contractor.</li> <li>2. Carry out investigation.</li> <li>3. Report the results of investigation to IEC and the Contractor.</li> <li>4. Discuss with the Contractor and formulate remedial measures.</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol style="list-style-type: none"> <li>1. Review with analysed results submitted by ET.</li> <li>2. Review the proposed remedial measures by the Contractor and advise ER accordingly.</li> <li>3. Supervise the implement of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC.</li> <li>2. Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol style="list-style-type: none"> <li>1. Notify IEC, ER, EPD and the Contractor.</li> <li>2. Identify the source.</li> <li>3. Repeat measurement to confirm findings.</li> <li>4. Increase monitoring frequency.</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented.</li> <li>6. Inform IEC, ER, and EPD the causes &amp; actions taken for the exceedances.</li> <li>7. Assess effectiveness of the Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET Leader and the Contractor on the potential remedial actions.</li> <li>2. Review the Contractor's remedial actions whenever necessary to assure their effectiveness and advise ER accordingly.</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing.</li> <li>2. Notify the Contractor.</li> <li>3. Require the Contractor to propose remedial measures for the analysed noise problem.</li> <li>4. Ensure remedial measures are properly implemented.</li> <li>5. If exceedance continues, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance.</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification.</li> <li>3. Implement the agreed proposals.</li> <li>4. Resubmit proposals if problem still not under control.</li> <li>5. Stop the relevant activity of works as determined by the ER until the exceedance is abated.</li> </ol>

**Event and Action Plan for Water Quality**

Event	Action			
	ET Leader	IEC	ER	Contractor
Action level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Repeat in-situ measurement on next day of exceedance to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Inform IEC, Contractor &amp; ER;</li> <li>4. Check monitoring data, all plant, equipment &amp; contractor's working methods;</li> </ol>	<ol style="list-style-type: none"> <li>1. Check monitoring data submitted by ET &amp; Contractor's working methods;</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing; Notify, Contractor</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the ER &amp; confirm notification of the non-compliance in writing;</li> <li>2. Rectify unacceptable practice;</li> <li>3. Amend working methods if appropriate.</li> </ol>
Action level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> <li>1. Repeat measurement on next day of exceedance to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Inform IEC, Contractor, ER &amp; EPD;</li> <li>4. Check monitoring data, all plant, equipment &amp; Contractor's working methods;</li> <li>5. Discuss mitigation measures with IEC, ER &amp; Contractor;</li> <li>6. Ensure mitigation measures are implemented;</li> <li>7. Increase monitoring to daily until no exceedance of Action level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Checking monitoring data submitted by ET &amp; Contractor's working method;</li> <li>2. Discuss with ET &amp; Contractor on possible remedial actions;</li> <li>3. Review the proposed mitigation measures submitted by Contractor &amp; advise the ER accordingly;</li> <li>4. Supervise the implementation of mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with IEC on the proposed mitigation measures;</li> <li>2. Ensure mitigation measures properly implemented;</li> <li>3. Assess the effectiveness of the implemented mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the Engineer &amp; confirm notification of the non-compliance in writing;</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant &amp; equipment &amp; consider changes of working methods;</li> <li>4. Submit proposal of mitigation measures to ER within 3 working days of notification &amp; discuss with ET, IEC &amp; ER;</li> <li>5. Implement the agreed mitigation measures.</li> </ol>



Event	Action			
	ET Leader	IEC	ER	Contractor
Limit level being exceeded by one sampling day	<ol style="list-style-type: none"> <li>1. Repeat measurement on next day of exceedance to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Inform IEC, contractor, ER &amp; EPD;</li> <li>4. Check monitoring data, all plant, equipment &amp; contractor's working methods;</li> <li>5. Discuss mitigation measures with IEC, Contractor &amp; ER.</li> </ol>	<ol style="list-style-type: none"> <li>1. Checking monitoring data submitted by ET &amp; Contractor's working method;</li> <li>2. Discuss with ET &amp; Contractor on the possible mitigation measures;</li> <li>3. Review the proposed mitigation measures submitted by Contractor &amp; advise the ER accordingly.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Discuss with IEC, ET &amp; Contractor on the proposed mitigation measures;</li> <li>3. Request Contractor to review the working methods.</li> </ol>	<ol style="list-style-type: none"> <li>1. Inform the ER &amp; confirm notification of the non-compliance in writing;</li> <li>2. Rectify unacceptable practice;</li> <li>3. Check all plant &amp; equipment &amp; consider changes of working methods;</li> <li>4. Submit proposal of mitigation measures to ER within 3 working days of notification &amp; discuss with ET, IEC &amp; ER.</li> </ol>
Limit level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> <li>1. Repeat measurement on the next day of exceedance to confirm findings;</li> <li>2. Identify source(s) of impact;</li> <li>3. Inform IEC, Contractor, ER &amp; EPD;</li> <li>4. Check monitoring data, all plant, equipment &amp; Contractor's working methods;</li> <li>5. Discuss mitigation measures within IEC, Contractor &amp; ER;</li> <li>6. Ensure mitigation measures are implemented;</li> <li>7. Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days.</li> </ol>	<ol style="list-style-type: none"> <li>1. Checking monitoring data submitted by ET &amp; Contractor's working method;</li> <li>2. Discuss with ET &amp; Contractor on potential remedial actions;</li> <li>3. Review Contractor's mitigation measures whenever necessary to assure their effectiveness &amp; advise the ER accordingly;</li> <li>4. Supervise the implementation of mitigation measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss with IEC, ET &amp; Contractor on the proposed mitigation measures;</li> <li>2. Request Contractor to critically review the working methods;</li> <li>3. Make agreement on the mitigation measures to be implemented;</li> <li>4. Ensure mitigation measures are properly implemented;</li> <li>5. Consider &amp; instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposal of mitigation measures to ER within 3 working days of notification &amp; discuss with ET, IEC &amp; ER;</li> <li>3. Implement the agreed mitigation measures;</li> <li>4. Resubmit proposals of mitigation measures if problem still not under control;</li> <li>5. As directed by the Engineer, to slow down or to stop all or part of the construction activities until no exceedance of Limit level.</li> </ol>

# **Appendix H Noise Monitoring Results and their Graphical Presentation**

**Appendix H**  
**Noise Monitoring Results and their Graphical Presentation**

Noise Monitoring Result at SR77

Date	Weather Condition	Start Time	End Time	Measured Noise Level (dB(A))*			Baseline Corrected Level, dB(A)**	Baseline Noise Level (dB(A)), Leq(30min)	Limit Level dB(A)
				L10(30min)	L90(30min)	Leq(30min)			
2018-06-05	Rainy	11:30	12:00	65.5	60.0	62.0	-	67.8	75.0
2018-06-11	Sunny	11:30	12:00	75.5	62.5	69.5	-	67.8	75.0
2018-06-21	Fine	11:30	12:00	75.0	64.5	68.5	-	67.8	75.0
2018-06-27	Fine	11:30	12:00	80.5	63.5	72.0		67.8	75.0
						<b>Average</b>	68.0		
						<b>Minimum</b>	62.0		
						<b>Maximum</b>	72.0		


**Remarks**

\* +3dB(A) Façade effect correction included


\*\* Baseline corrected level is only calculated when measured noise level (Leq) > limit level.

\*\*\* Data in **80.5** denotes exceedance of respective Limit Level

### Noise monitoring result: SR77

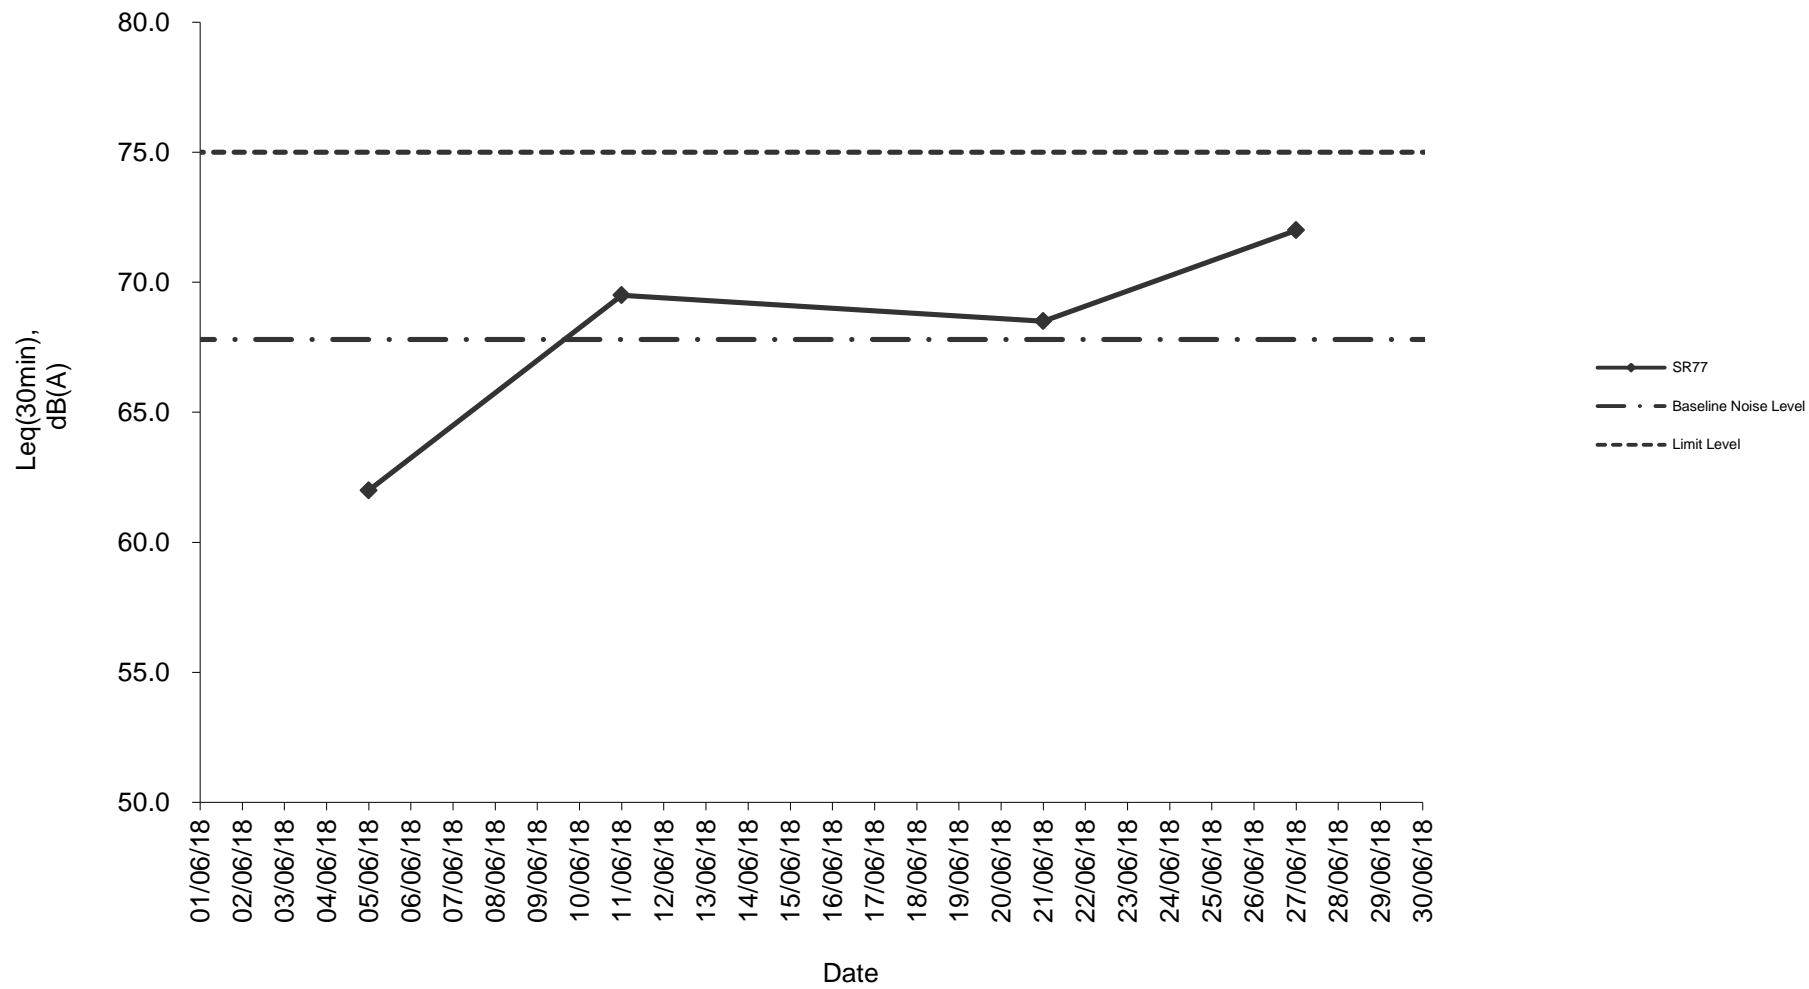

**Noise monitoring result: SR77  
(March 2018 - June 2018)**

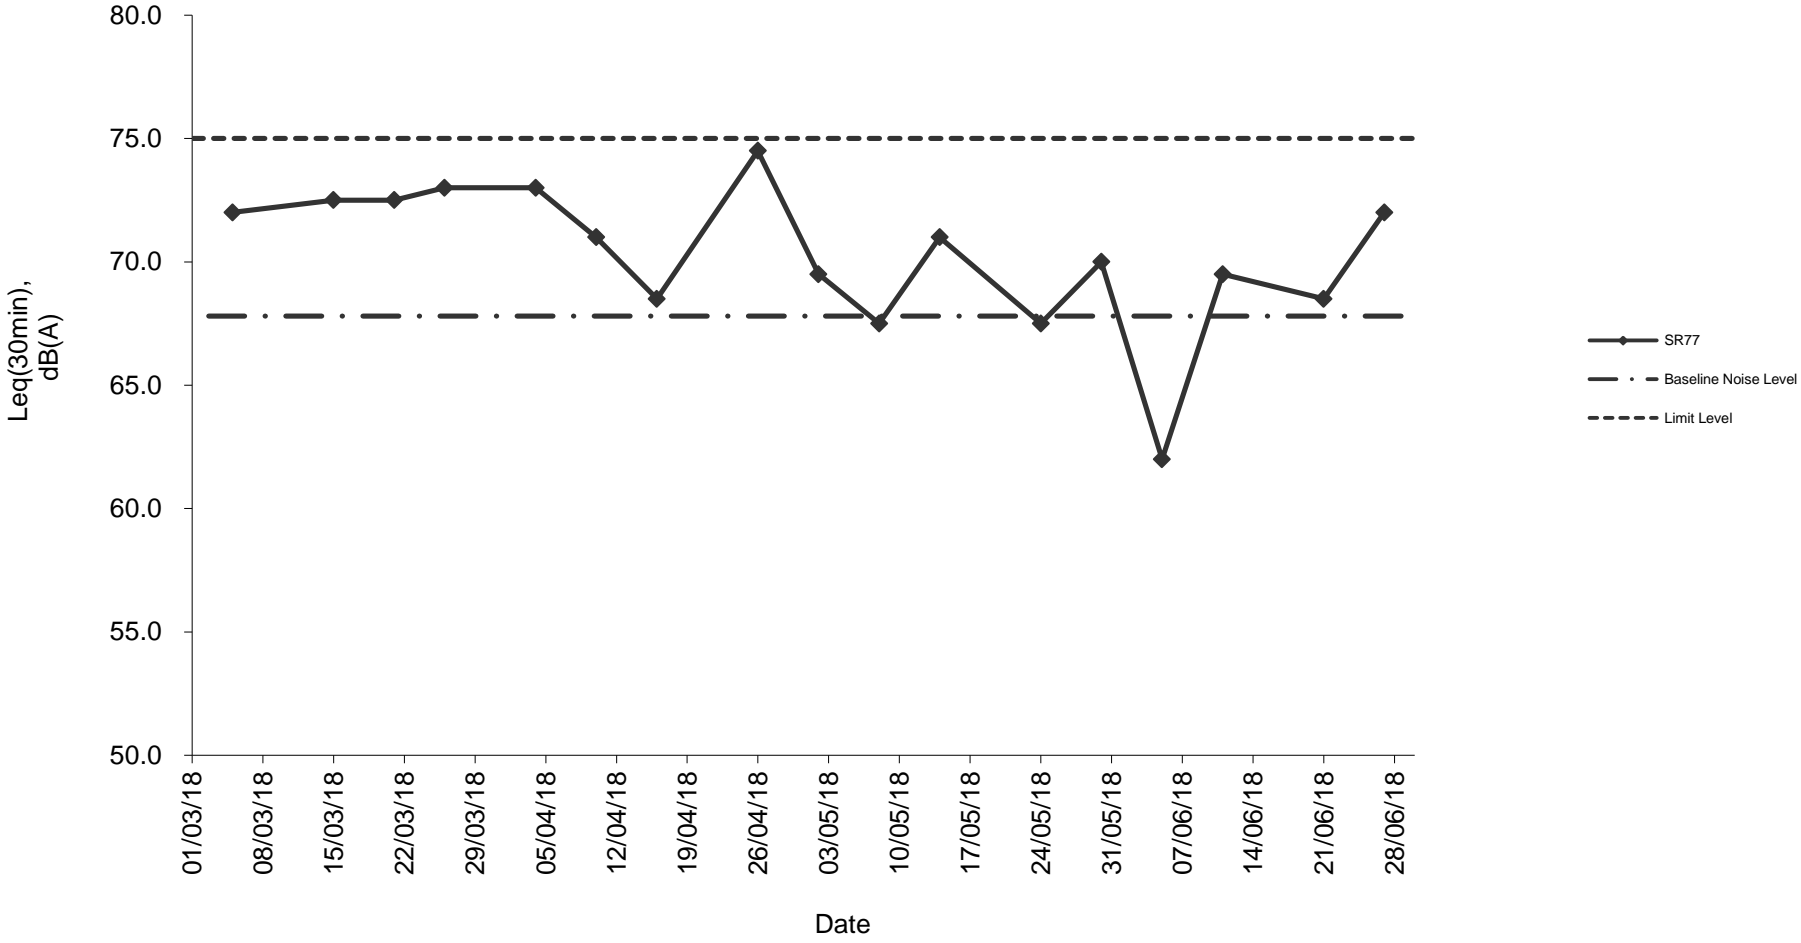

# Appendix K Waste Flow Table

### Monthly Summary Waste Flow Table

Month	Actual Quantities of Inert C&D Materials Generated Monthly							Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated	Hard Rock and Large Broken Concrete	Soil	Soil Reused in the Contract	Soil Reused in other Projects	Soil Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging (Note 3)	Plastics	Chemical Waste	General Refuse (Note 2)
Unit	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in m <sup>3</sup> )	(in '000m <sup>3</sup> )
Jan-18	3.089	0.304	2.785	0.060	-	2.725	0.923	-	-	-	-	0.150
Feb-18	2.698	0.256	2.442	0.150	-	2.292	1.144	-	-	-	-	0.095
Mar-18	1.524	0.141	1.383	0.120	-	1.263	0.211	-	-	-	-	0.085
Apr-18	2.880	0.786	2.094	0.360	-	1.734	0.788	-	-	-	-	0.125
May-18	1.164	0.290	0.874	0.101	-	0.773	0.185	-	-	-	-	0.150
Jun-18	0.862	0.082	0.780	0.515	-	0.265	0.000	-	-	-	-	0.110
Sub-Total	12.217	1.859	10.358	1.306	-	9.052	3.251	-	-	-	-	0.715
Jul-18	-	-	-	-	-	-	-	-	-	-	-	-
Aug-18	-	-	-	-	-	-	-	-	-	-	-	-
Sep-18	-	-	-	-	-	-	-	-	-	-	-	-
Oct-18	-	-	-	-	-	-	-	-	-	-	-	-
Nov-18	-	-	-	-	-	-	-	-	-	-	-	-
Dec-18	-	-	-	-	-	-	-	-	-	-	-	-
Total	12.217	1.859	10.358	1.306	-	9.052	3.251	-	-	-	-	0.715

- Note:
1. Assume the density of soil fill is 2 ton/m<sup>3</sup>.
  2. Assume the density of rock and broken concrete is 2.5 ton/m<sup>3</sup>.
  3. Assume each truck of C&D wastes is 5m<sup>3</sup>.
  4. The inert C&D materials except slurry and bentonite are disposed at Tuen Mun 38.
  5. The slurry and bentonite are disposed at Tseung Kwun O 137.
  6. The non-inert C&D wastes are disposed at NENT.
  7. Assume the density of metal is 7,850 kg/m<sup>3</sup>.
  8. Assume the density of plastic is 941 kg/m<sup>3</sup>.
  9. Assume the density of paper is 800 kg/m<sup>3</sup>.

# **Appendix L Implementation Schedule of Environmental Mitigation Measures (EMIS)**



Impact	Environmental Protection Measures	Timing	Responsibility	Implementation Status #
<b>Air Quality</b>				
Air Quality during Construction	<ul style="list-style-type: none"> <li>Restricting heights from which materials are dropped, as far as practicable to minimize the fugitive dust arising from unloading/loading.</li> <li>All stockpiles of excavated materials or spoil of more than 50m<sup>3</sup> shall be enclosed, covered or dampened during dry or windy conditions.</li> <li>Effective water sprays shall be used to control potential dust emission sources such as unpaved haul roads and active construction areas.</li> <li>All spraying of materials and surfaces shall avoid excessive water usage.</li> <li>Vehicles that have the potential to create dust while transporting materials shall be covered, with the cover properly secured and extended over the edges of the side and tail boards.</li> <li>Materials shall be dampened, if necessary, before transportation.</li> <li>Travelling speeds shall be controlled to reduce traffic induced dust dispersion and re-suspension within the site from the operating haul trucks.</li> <li>Vehicle washing facilities shall be provided to minimise the quantity of material deposited on public roads.</li> </ul>	During Construction	Contractor	<ul style="list-style-type: none"> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> <li>✓</li> </ul>
Air Quality during Operation	Not required	N/A	N/A	N/A
<b>Noise</b>				
Noise during Construction	<ul style="list-style-type: none"> <li>Use of silenced plant or plant equipped with mufflers or dampers in substitute of ordinary plant.</li> <li>Reduce the number of equipment and their percentage on-time.</li> </ul>	During Construction	Contractor	<ul style="list-style-type: none"> <li>✓</li> <li>✓</li> </ul>
Noise during Operation	Not required	N/A	N/A	N/A
<b>Water Quality</b>				
Water Quality during Construction	<u>Road Widening Works, Earthworks and Culvert Extension Works</u> <ul style="list-style-type: none"> <li>Wastewater generated from any concrete batching washdown of equipment or similar activities should be discharged into foul sewers, after the removal of settleable solids, and pH adjustment as necessary. All sewage discharges from the study area should meet the TM standards and approval from EPD through the licensing process is required.</li> </ul>	During Construction	Contractor	Rem.

Notes (#): ✓ – Compliance; Rem – Reminder; Obs – Observation; N/C – Non Compliance; N/A – Not Applicable

Impact	Environmental Protection Measures	Timing	Responsibility	Implementation Status #
	<ul style="list-style-type: none"> <li>• Sand traps, oil interceptors and other pollution prevention installations should be provided, properly cleaned and maintained.</li> <li>• Runoff from exposed working areas, unfinished slopes and from unlined temporary channels should be directed to stilling basins and/or silt traps before discharging to the drainage outfalls.</li> <li>• Regular inspections of stilling basins and/or silt traps is required to ensure that sediment is not conveyed into the existing drainage system.</li> <li>• Open stockpiles should be covered with a tarpaulin cover.</li> <li>• During the wet season, any exposed top soils should be covered with a tarpaulin, shotcreted or hydroseeded.</li> <li>• Sand and silt from wash-water from vehicle washing should be settled out before discharging into storm drains.</li> <li>• Fuels should be stored in bunded areas such that spillage can be easily collected.</li> </ul>			✓  ✓  ✓  ✓  ✓  ✓
Water Quality during Operation	Not required	N/A	N/A	N/A
<b>Waste Management</b>				
Waste Management during Construction	<u>General Waste</u> <ul style="list-style-type: none"> <li>• Transport of wastes off site as soon as possible.</li> <li>• Maintenance of accurate waste records.</li> <li>• Minimisation of waste generation for disposal (via reduction/recycling/re-use).</li> <li>• No on-site burning will be permitted.</li> <li>• Use of re-useable metal hoardings/signboards.</li> </ul> <u>Vegetation from site clearance</u> <ul style="list-style-type: none"> <li>• Segregation of materials to facilitate disposal.</li> <li>• Mulching to reduce bulk and where possible review opportunities for the possible beneficial use within landscaping areas.</li> </ul>	During Construction   During Construction	Contractor   Contractor	✓  ✓  Obs.  ✓  ✓  ✓  ✓

Notes (#): ✓ – Compliance; Rem – Reminder; Obs – Observation; N/C – Non Compliance; N/A – Not Applicable

Impact	Environmental Protection Measures	Timing	Responsibility	Implementation Status #
	<p><u>Demolition Wastes</u></p> <ul style="list-style-type: none"> <li>• Segregation of materials to facilitate disposal.</li> <li>• Appropriate stockpile management.</li> </ul> <p><u>Excavated Materials</u></p> <ul style="list-style-type: none"> <li>• Segregation of materials to facilitate disposal / reuse.</li> <li>• Appropriate stockpile management.</li> <li>• Re-use of excavated material on or off site (where possible).</li> <li>• Special handling and disposal procedures in the event that contaminated materials are excavated.</li> </ul> <p><u>Construction Wastes</u></p> <ul style="list-style-type: none"> <li>• Segregation of materials to facilitate recycling/reuse (within designated area in appropriate containers/stockpiles).</li> <li>• Appropriate stockpile management.</li> <li>• Planning to reduce over ordering and waste generation.</li> <li>• Recycling and re-use of materials where possible (e.g. metal, wood from formwork)</li> <li>• For material which cannot be re-used/recycled, collection should be carried out by an approved waste contractor for landfill disposal.</li> </ul> <p><u>Bentonite Slurries</u></p> <ul style="list-style-type: none"> <li>• Bentonite slurries should be reused as far as possible.</li> <li>• Disposal in accordance with Practice Note For Professional Persons ProPECC PN 1/94.</li> </ul> <p><u>Chemical Wastes</u></p> <ul style="list-style-type: none"> <li>• Storage within locked, covered and bunded area.</li> <li>• The storage area shall not be located adjacent to sensitive receivers e.g. drains.</li> <li>• Minimise waste production and recycle oils/solvents where possible.</li> </ul>	<p>During Construction</p> <p>During Construction</p> <p>During Construction</p> <p>During Construction</p>	<p>Contractor</p> <p>Contractor</p> <p>Contractor</p> <p>Contractor</p>	<p>✓</p> <p>✓</p> <p>✓</p> <p>✓</p> <p>✓</p> <p>N/A</p> <p>✓</p> <p>✓</p> <p>✓</p> <p>✓</p> <p>✓</p> <p>N/A</p> <p>N/A</p> <p>✓</p> <p>✓</p> <p>✓</p>

Notes (#): ✓ – Compliance; Rem – Reminder; Obs – Observation; N/C – Non Compliance; N/A – Not Applicable

Impact	Environmental Protection Measures	Timing	Responsibility	Implementation Status #
	<ul style="list-style-type: none"> <li>● A spill response procedure shall be in place and absorption material available for minor spillages.</li> <li>● Use appropriate and labelled containers.</li> <li>● Educate site workers on site cleanliness/waste management procedures.</li> <li>● If chemical wastes are to be generated, the contractor must register with EPD as a chemical waste producer.</li> <li>● The chemical wastes shall be collected by a licensed chemical waste collector.</li> </ul> <p><u>Municipal Wastes</u></p> <ul style="list-style-type: none"> <li>● Waste shall be stored within a temporary refuse collection facility, in appropriate containers prior to collection and disposal.</li> <li>● Regular, daily collections are required by an approved waste collector.</li> </ul>	During Construction	Contractor	✓ ✓ ✓ ✓ ✓ ✓
Waste Management during Operation	Not required.	N/A	N/A	N/A
<b>Ecology</b>				
Ecology during Construction	<p><u>Accurate Delineation of Works Area</u></p> <ul style="list-style-type: none"> <li>● Boundaries of proposed works areas shall be clearly identified and separated from external areas by a physical barrier to prevent encroachment of adjacent habitats.</li> <li>● Individual trees which fall within the works areas but which work plans show do not require removal are to be retained and fenced off to maximise protection.</li> </ul> <p><u>Dust generation</u></p> <p>There are a number of measures which shall be taken as specified in the Air Pollution Control (Construction Dust) Regulation on 'Dust Control Requirements, including the following key measures to be applied during construction:</p> <ul style="list-style-type: none"> <li>● vehicle washing facilities to be provided at every discernible or designated vehicle exit point;</li> </ul>	During Construction          During Construction	Contractor          Contractor	✓          ✓

Notes (#): ✓ – Compliance; Rem – Reminder; Obs – Observation; N/C – Non Compliance; N/A – Not Applicable

Impact	Environmental Protection Measures	Timing	Responsibility	Implementation Status #
	<ul style="list-style-type: none"> <li>● all temporary site access roads shall be sprayed with water to suppress dust as necessary;</li> <li>● all dusty materials should be sprayed with water immediately prior to any handling; and</li> <li>● all debris should be covered entirely by impervious sheeting or stored in a sheltered debris collection area.</li> </ul> <p><u>Surface Run-off</u></p> <p>In general, mitigation measures shall be in accordance with ProPECC PN1/94 on 'Construction Site Drainage'. Key measures include:</p> <ul style="list-style-type: none"> <li>● Bund and cover stockpiles to avoid run-off;</li> <li>● Channel any run-off through a system of oil, grease and sediment / silt traps and reuse water on site where ever practical;</li> <li>● All vehicle maintenance to be undertaken within a bunded area; and</li> <li>● Maximise vegetation retention on-site to maximise absorption (minimise transport).</li> </ul>	During Construction	Contractor	✓  ✓  ✓  ✓  ✓  ✓
Ecology during Operation	<ul style="list-style-type: none"> <li>● To conduct compensatory ecological planting as specified in the latest landscape plans approved by EPD (Clause 2.6 of the Environmental Permit refers).</li> </ul>	During Construction and operation	Contractor (during construction) / LCSD* (during operation) (Note: * The division of vegetation planting and maintenance responsibilities shall follow the guidelines stipulated in ETWB TCW No. 2/2004.)	N/A
<b>Landscape and Visual</b>				
Landscape and Visual during Construction	<p><u>Preservation of Existing Vegetation</u></p> <ul style="list-style-type: none"> <li>● Trees identified for retention within the project limit would be protected during the works</li> <li>● The tree transplanting and planting works shall be implemented by approved Landscape Contractors</li> </ul>	During Construction	Contractor	✓  ✓

Notes (#): ✓ – Compliance; Rem – Reminder; Obs – Observation; N/C – Non Compliance; N/A – Not Applicable

Impact	Environmental Protection Measures	Timing	Responsibility	Implementation Status #
	<p><u>Temporary Works Areas</u>                      Where feasible the works areas would be screened using hoarding and existing vegetation would be retained where possible to reduce the landscape and visual impacts arising from the construction activity. The landscape of these works areas would be restored following the completion of the construction phase.</p> <p><u>Hoarding</u>                      A hoarding would be erected where practicable in the most visually sensitive locations to screen the temporary construction works from the local VSRs.</p> <p><u>Top Soils</u>                      The works will result in disturbance to extensive areas of topsoil. Topsoil worthy of retention should be stockpiled for use following completion of the civil engineering works. It should either be temporarily vegetated with hydroseeded grass or turned over on a regular basis.</p> <p><u>Protection of Important Landscape Features</u>                      Important features such as temples, Island House and kilns within the study area, although remote from the proposed works retained and adequately protected.</p>	During Construction	Contractor	✓
		During Construction	Contractor	✓
		During Construction	Contractor	N/A
		During Construction	Contractor	N/A
Landscape and Visual during Operation	Not required.	N/A	N/A	N/A

Notes (#): ✓ – Compliance; Rem – Reminder; Obs – Observation; N/C – Non Compliance; N/A – Not Applicable

# **Appendix N**

## **Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions**

**Cumulative Complaint Log**

Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
C131126	26, November, 2013	Mr. Tony Hung from WWF	Mat Wat River (works sites for box culvert extension)	Suspected unauthorised discharge of water from a construction site to Ma Wat River, Tai Wo Service Road East, Tai Po	<p>It was found that the water leaving the end of the steel pipes was the diverted water from the upstream of the existing box culverts, instead of being discharged from the construction works sites.</p> <p>An EM&amp;A Programme is being undertaken to monitoring the environmental performance of the construction works, and the Contractor has also implemented appropriate mitigation measures to avoid silt-laden runoff discharging from the works sites into the river.</p> <p>The complaint is considered an invalid complaint under this Project.</p>	Completed



Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
C141120	20 November, 2014	EPD	Ng Tung River and Ma Wat River nearby the site of the Liantang/ Heung Yuen Wai BCP Project (Contract Number CV/2012/09)	At Bridge NF426 in Fanling, the whole Ng Tung River showed milky and suspected illegal discharge by nearby factory has undertaken. (粉嶺近天橋編號 NF426 梧桐河整條河河水呈奶白色懷疑附近有工廠非法排放污水)	<p>Water Supplies Department (WSD) conducted a washout procedure on 20 November 2014 at about 9:30am to flush the newly installed water pipe of diameter of 1400mm which has recently finished disinfection. It is understood that the procedure has lasted for about 1 hour and large amount of freshwater has been discharged into the Ma Wat River through a washout port.</p> <p>Although water was observed seeping from the gantry switch and flew into the works sites, the area is a sump pit and the water was unlikely to run off and entered the river directly. As such, it is anticipated that only freshwater has been discharged into Ma Wat River through the washout port.</p> <p>Both site inspections conducted by the ET before the complaint (19 November 2014), and after the complaint (24 November 2014) did not identify any deficiencies on environmental mitigation measures. Also, there were no rains during the period and the risk of construction site run-off is considered minimal.</p>	Completed

Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
					<p>The water from the Ma Wat Channel adjoins the Ng Tung River before passing through the complaint location, so other pollution sources may also occur at upstream of Ng Tung River</p> <p>The complaint is considered unlikely due to the construction works of this project.</p>	
C171228	28 December, 2017	1823	Kau Lung Hang and Hong Lok Yuen	<p>Air quality issue nearby Kau Lung Hang and Hong Lok Yuen area. Stockpiling within the Project area was observed to be uncovered, causing dust dispersion within the area. (大埔九龍坑附近的空氣污染問題嚴重。吐露港公路蓮塘口岸隧道工程經常見到沙泥沒有覆蓋，導致沙土飛揚散佈九龍坑，康樂園一帶，造成極大困擾與明顯健康風險。要求立即改善，懲罰相</p>	<p>The Environmental Team (ET) was informed of the complaint through Chun Wo and CEDD via 1823 online-enquiry/ complaint form received on 28 December 2017 at 9:04am. Investigation was triggered in accordance with the procedures as specified in Section 7.3 of the EM&amp;A Manual. A joint investigation by the ET and the IEC was conducted on 28 December 2017.</p> <p>As advised by the Contractor, no construction works were carried out during the public holiday.</p> <p>No exceedance of TSP level at the air monitoring station under this Contract was recorded in the past six months except 8 December 2017.</p>	

Complaint Log No.	Date of Complaint	Received From and Received By	Location of Complainant	Nature of Complaint	Outcome	Status
				<p>關建築商。附圖是該區狀況。昨日洗車，一日已經沙塵滿佈。)</p>	<p>Exceedance on 8 December 2017 was considered not project related as no major excavation works located close to the monitoring location at SR77.</p> <p>Based on the routine environmental site inspection and information provided by the Contractor, it is considered that dust suppression measures have been implemented to minimize dust nuisance arising from the works areas. Nonetheless, the ET and IEC will continue the auditing and reviewing of the Contractor's implementation of mitigation measures during the construction period.</p>	



**Meinhardt Infrastructure and  
Environment Ltd**  
邁進基建環保工程顧問有限公司

10/F Genesis  
33-35 Wong Chuk Hang Road  
Hong Kong  
香港黃竹坑道33-35號  
創協坊10樓

Tel 電話: +852 2858 0738  
Fax 傳真: +852 2540 1580

[mail@meinhardt.com.hk](mailto:mail@meinhardt.com.hk)  
[www.meinhardt-china.com](http://www.meinhardt-china.com)  
[www.meinhardtgroup.com](http://www.meinhardtgroup.com)