
# Vol. 3 of 5 FEP-03/457/2013/D Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 March 2023





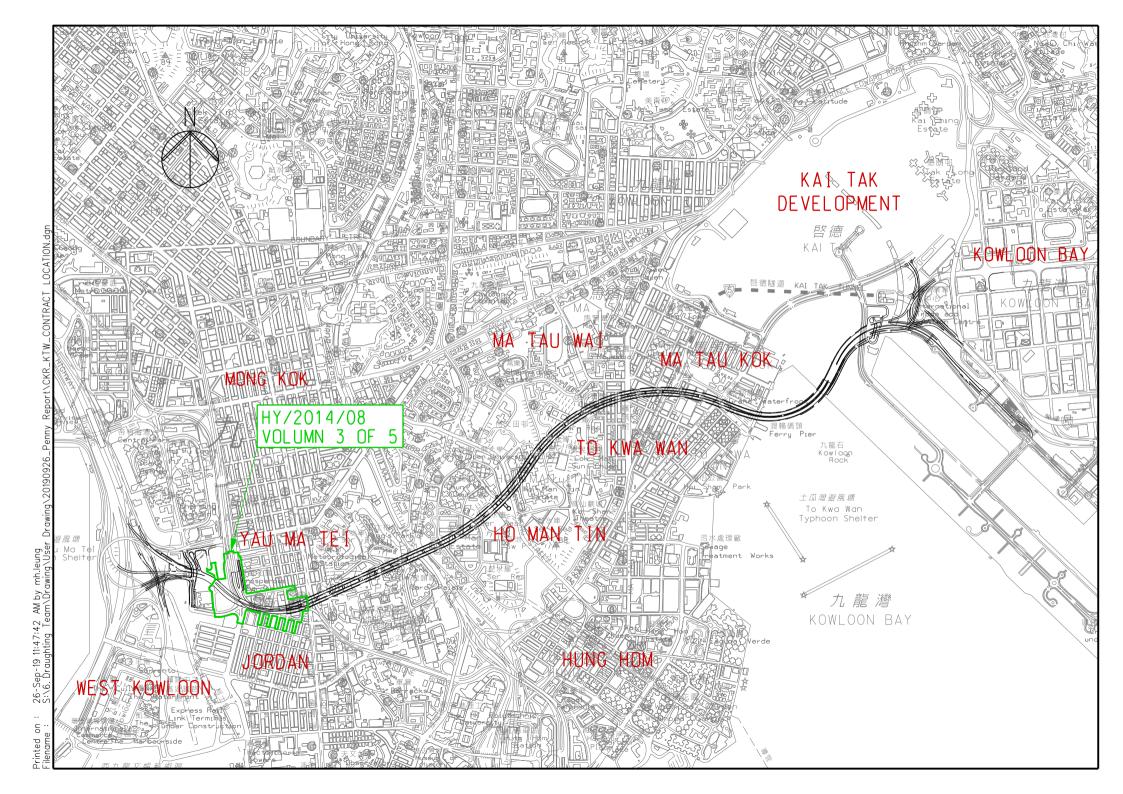

### Environmental Permit No. EP-457/2013/D

### **Central Kowloon Route**

### **Independent Environmental Checker Verification**

Reference Document/Plan	
Document/ <del>Plan</del> to be <del>Certified</del> / Verified:	Monthly EM&A Report No.60 (March 2023)
Date of Report:	12 April 2023 (Rev. 1)
Date received by IEC:	12 April 2023

Yau Ma Tei East (HY/2014/08)

### **Reference EP Condition**

**Works Contract:** 

**Environmental Permit Condition:** 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

### **IEC Verification**

I hereby verify that the above referenced document/plan complies with the above referenced condition of EP-457/2013/D.

Mondy 20.

Ms Mandy To Date: 12 April 2023

Independent Environmental Checker

Our ref: 0436942\_IEC Verification Cert\_YMTE\_Monthly EM&A Rpt No.60.docx





# Build King – SK ecoplant Joint Venture

# Central Kowloon Route Contract HY/2014/08

Section of Yau Ma Tei East

Monthly EM&A Report No. 60

(Period from 1 to 31 March 2023)

Rev. 1

(12 April 2023)

	Name	Signature
Prepared by	Kako H.L. Ho (Assistant Environmental Consultant)	Ho
Checked & Reviewed by	Y.H. Law (Senior Environmental Consultant)	Malan
Approved & Certified by	Kevin W. M. Li (Environmental Team Leader)	K.

### TABLE OF CONTENTS

### **EXECUTIVE SUMMARY**

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	11
3.	MONITORING RESULTS	13
4.	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	21
5.	EM&A SITE INSPECTION	23
6.	FUTURE KEY ISSUES	24
7.	CONCLUSION AND RECOMMENDATIONS	25

### LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

### **EXECUTIVE SUMMARY**

- A.1 Build King SK ecoplant Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 60<sup>th</sup> monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 March 2023 to 31 March 2023.
- A.2 A summary of the construction works reported by Main Contractor for the Project during the reporting month is listed below.

### **Construction Activities undertaken**

- Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B
- Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone B
- Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone C
- Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone D
- Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, Dwall construction, install kingposts/recharge well/observation well/pumping well and Pumping Test at Zone F
- Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G
- Construct portal frame across, demolish existing Gascogine Road Flyover beams and construct end span at Portion 21
- Construct bridge deck for spans P2 to P6 at Gascogine Road Flyover
- Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts of Noise Enclosure at Zone 3
- Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

### Regular construction noise monitoring during normal working hours

W-N1A, W-P11, W-N18, W-N25A 5 times

### Construction dust (24-hour TSP) monitoring

W-A1 5 times W-A6 5 times

### **Construction dust (1-hour TSP) monitoring**

W-A1, W-A6 15 times

A.4 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 2, 16 and 23 March 2023. Details of the audit findings and implementation status are presented in Section 5.

- A.5 Joint weekly site inspections were conducted by representatives of the Environmental Team (ET), Contractor and Engineer on 2, 9, 16, 23 and 30 March 2023. One joint site inspection with IEC was also undertaken on 9 March 2023. Details of the audit findings and implementation status are presented in Section 5.
- A.6 Details of waste management are presented in Section 3.
- A.7 Six Action Levels of construction noise were triggered during the reporting month as documented complaints were received. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Level of 24-hour TSP and 1-hour TSP was recorded in the reporting month.
- A.8 A total of seven environmental complaints were received in the reporting month. After investigation with Contractor, one complaint related to construction noise during restricted hour may pose potential compliance concern on CNP condition. Precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- A.9 No notification of summon or prosecution was received in this reporting month.
- A.10 A summary of the construction activities provided by Main Contractor in the next reporting month is listed below:

### **Construction Activities to be undertaken**

- Construction of Road Slab at Zone A
- Construction of roof slab at west of box culvert and Excavation and Lateral Support works to roof slab at east side of box culvert of Zone B
- Install hanger support for existing box culvert at Zone B excavation to roof slab in Zones B, C and D including remaining roof slab construction at Zone C3 and removal of cross wall (D-wall) between Zone C3 and D1 by coring and saw cutting. In Zone D2 & D3 Excavation and Lateral Support works for L5 and L6
- Underground Utilities diversion and D-wall construction at Zone B3
- Underground Utilities diversion, jet grouting, pre-boring works and D-wall construction at Zone
- Complete pipe piling and continue for D-wall construction and Underground Utilities diversion at Zone G
- Works for reprovisioning of Gascogine Road Flyover at HKAA area: Installation of temporary furniture and stressing of external tendon works
- Bridge Works:
  - i. All 50 nos. deck segments for eastbound Gascogine Road Flyover have been cast
  - Complete road furniture, external tendon stressing works, road pavement works and miscellaneous works prior to traffic diversion to new eastbound Gascogine Road Flyover
  - iii. Construct P5R deck construction
- Continue Excavation and Lateral Support and construction works for pile caps and ground beams construction for middle / east /west foundation for F02 Noise Enclosure

### **Construction Activities to be undertaken**

- Erection of Y columns, side columns and main beams for Noise Enclosure F02 in Zone 3 (night works)
- Works at Zone 2 Noise Enclosure scheduled as the following:
  - i. Column A Pile cap construction
  - ii. Column E Column erection following approval of TTA Scheme and delivery of steel column;
  - iii. Columns G Socket H- piling works
  - iv. Column A1 Erect steel tower following fabrication and delivery of steel tower
  - v. Columns C Complete design and fabrication of steel footing and install steel footing
  - vi. Columns D Complete design and fabrication of steel footing and install steel footing
- Noise Enclosure steelworks fabrication at Fabrication Yard in Zhuhai, China
- Monitoring of instrumentation for all areas

### 1. Basic Project Information

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was applied for and the EP (EP-457/2013/C) was issued by EPD on 16 January 2017. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/D) was issued by EPD on 15 June 2021. A Further EP (FEP-03/457/2013/D) was issued by EPD on 5 November 2021.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
  - · Section of Yau Ma Tei East
  - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
  - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
  - iii. Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
  - iv. Demolition and re-provisioning of Gascoigne Road Flyover and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
  - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route Tunnel Electrical & Mechanical contract
  - vi. Design and construction of Noise Barrier Works
  - vii. Prepare temporary traffic arrangement proposals, discuss at Traffic Management Liaison Group meeting and obtain its agreement and approval/endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

### **Construction Activities undertaken**

- Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B
- Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone B
- Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone C
- Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone D
- Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, Dwall construction, install kingposts/recharge well/observation well/pumping well and Pumping Test at Zone F
- Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G
- Construct portal frame across, demolish existing Gascogine Road Flyover beams and construct end span at Portion 21
- Construct bridge deck for spans P2 to P6 at Gascogine Road Flyover
- Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts of Noise Enclosure at Zone 3
- Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2
  - 1.5. The project organisational chart specifying management structure and contact details are shown in Appendix C.
- 1.6. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2.

Table 1.2 Summary of the Status of Valid Environmental Licence

### Notification, Permit and Documentations

Permit/ Licences/	Valid	Period		
Notification /Reference No.	From	То	Status	Remark
<b>Environmental Permit</b>				
EP-457/2013/D	15 Jun 2021	End of Project	Valid	-
<b>Further Environmental 1</b>	Permit			
FEP-03/457/2013/D	5 Nov 2021	End of Project	Valid	
Wastewater Discharge Li	cense			
WT00030660-2018	28 Mar 2018	31 Mar 2023	Supersede by WT00043433- 2023	-
WT00043433-2023	17 Mar 2023	31 Mar 2028	Valid	-
<b>Notification of Constructi</b>	Notification of Construction Works under the Air Pollution Control (Construction Dust) Regulation			
471691	14 Sep 2021	End of Project	Notified	-
Chemical Waste Producer Registration				
WPN5213-225-B2526-01	14 Mar 2018	End of Project	Valid	-
Billing Account for Disposal of Construction Waste				
7029997	1 Feb 2018	End of Project	Valid	-

Permit/ Licences/ Valid Period Notification			
From	То	Status	Remark
it			
19 Jan 2023	18 Apr 2023	Valid	Construction Noise Permit at Zone 3
1 Mar 2023	30 Apr 2023	Valid	Construction Noise Permit for Erection of Enclosure at Zone 3
20 Jan 2023	19 Apr 2023	Valid	Construction Noise Permit at Zone B3 & F
21 Jan 2023	20 Apr 2023	Valid	Construction Noise Permit at Zone B2 & C
22 Oct 2022	19 Apr 2023	Valid	Construction Noise Permit at Zone A & B1
2 Mar 2023	1 Apr 2023	Valid	Construction Noise Permit at Zone D & P3
20 Nov 2022	19 May 2023	Valid	Construction Noise Permit at P6
7 Feb 2023	29 Apr 2023	Valid	Construction Noise Permit for disassembly, assembly and launching of Form Traveler at Kansu Street between Shanghai Street and Canton Road
7 Feb 2023	29 Apr 2023	Valid	Construction Noise Permit at GRF for Temporary Erection of Bridge Decking
11 Feb 2023	31 Mar 2023	Expired during reporting month	Construction Noise Permit for Central Divider Removal at GRF
16 Jan 2023	15 Apr 2023	Valid	Construction Noise Permit at Multi-storey Carpark Building
6 Feb 2023	31 Mar 2023	Expired during reporting month	Construction Noise Permit for Relocating Plant Pots
7 Mar 2023	6 Jun 2023	Valid	Bridge Works at Shanghai Street
Marine Dumping Permit			
23 Dec 2022	22 Jun 2023	Valid	Type 1 – Open Sea Disposal
	From t  19 Jan 2023  1 Mar 2023  20 Jan 2023  21 Jan 2023  22 Oct 2022  2 Mar 2023  20 Nov 2022  7 Feb 2023  7 Feb 2023  11 Feb 2023  16 Jan 2023  7 Mar 2023	From To  t  19 Jan 2023	From         To         Status           t         19 Jan 2023         18 Apr 2023         Valid           1 Mar 2023         30 Apr 2023         Valid           20 Jan 2023         19 Apr 2023         Valid           21 Jan 2023         20 Apr 2023         Valid           22 Oct 2022         19 Apr 2023         Valid           2 Mar 2023         1 Apr 2023         Valid           7 Feb 2023         29 Apr 2023         Valid           7 Feb 2023         29 Apr 2023         Valid           11 Feb 2023         31 Mar 2023         Expired during reporting month           16 Jan 2023         15 Apr 2023         Valid           6 Feb 2023         31 Mar 2023         Expired during reporting month           7 Mar 2023         6 Jun 2023         Valid

Permit/ Licences/	Valid	Period		
Notification /Reference No.	From	То	Status	Remark
EP/MD/23-092	3 Feb 2023	2 Mar 2023	Supersede by EP/MD/23-108	Type 1 – Open Sea Disposal (Dedicated Site)
EP/MD/23-108	3 Mar 2023	2 Apr 2023	Valid	& Type 2 - Confined Marine Disposal

### 2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/D) and FEP (FEP-03/457/2013/D) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/D and FEP-03/457/2013/D for the Project

EP/FEP Condition (EP-457/2013/D) (FEP-03/457/2013/D)	Submission	Submission date
Condition 3.4	Monthly EM&A Report (Feb 2023)	14 Mar 2023

2.2. Details of the major construction activities reported by Main Contractor in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Construction activities undertaken	Remarks on progress
<ul> <li>Construct D-wall panels, pumping test, excavation to roof slab &amp; construct roof slab at Zone B</li> </ul>	• 97% completion
<ul> <li>Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone B</li> </ul>	• 52% completion
<ul> <li>Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone C</li> </ul>	• 65% completion
• Install Underground Utilities hanger support, excavation to roof slab and construct roof slab at Zone D	• 62% completion
<ul> <li>Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, D-wall construction, install kingposts/ recharge well/observation well/pumping well and Pumping Test at Zone F</li> </ul>	• 52% completion
<ul> <li>Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles /</li> <li>D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G</li> </ul>	• 52% completion
<ul> <li>Construct portal frame across, demolish existing Gascoigne Road flyover beams and construct end span at Portion 21</li> </ul>	• 99% completion
Construct bridge deck for spans P2 to P6 at Gascoigne Road flyover	• 97% completion
<ul> <li>Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts of Noise Enclosure at Zone 3</li> </ul>	• 84% completion
<ul> <li>Underground Utilities diversion, construct permanent &amp; temporary pipe piles, barrette walls for Noise Enclosure at Zone 2</li> </ul>	• 65% completion

2.3. The drawing showing the project layout and the location of the monitoring station and environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location are shown in Table 2.3.

Table 2.3 Summary for the location of the monitoring station

<b>Monitoring Location</b>	<b>Location ID</b>	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)*	W-A1/ W-N1A	22.31345	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

Remark: \*The High Volume Sampler (HVS) at dust impact monitoring location W-A1 had been relocated on 6 Sep 2022 due to installation work of PV panel at Yau Ma Tei Catholic Primary School. The relocation of HVS was approved by ER and agreed with IEC.

### 3. MONITORING RESULTS

3.1. Monitoring Parameters

### **Air Quality**

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

### **Noise**

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L<sub>eq</sub>). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as  $L_{10}$  and  $L_{90}$  shall also be obtained for reference.
- 3.2. Monitoring Equipment

### **Air Quality**

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificates of dust monitoring equipment are attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

$\mathcal{E}$ 1 1			
Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
	LD-5R Digital Dust Indicator	0Z4545	3 Apr 2022
1-hour TSP	LD-5R Digital Dust Indicator	992820	3 Apr 2022
1-Hour 1SP	PC-3A(E) Digital Dust Indicator	JC2002224	3 Apr 2022
	PC-3A(E) Digital Dust Indicator	JC2002225	3 Apr 2022
	TE-5170X High Volume	1084	2 Mar 2023 and 16
	Sampler		Mar 2023
24-hour TSP	TE-5170X High Volume	1050	2 Mar 2023 and 16
	Sampler		Mar 2023
	TE-5025A Calibration Kit	3465	28 Jun 2022

Table 3.1 Construction Dust Monitoring Equipment

### **Noise**

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.
- 3.2.6. Acoustic calibrators and sound level meters using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

racio 3.2 Monitoring Equipment esca in Monitoring			
Monitoring Equipment	Serial Number	Date of Calibration	
Nti XL2 Sound Level Meter	A2A-13661-E0	22 Aug 2022	
Rion NC-75 Sound Level	34524163	9 May 2022	

Table 3.2 Monitoring Equipment Used in Monitoring

3.3. Monitoring Methodology and QA/QC results

### **Air Quality**

- 3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R and PC-3A(E) digital dust indicator) were used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- ◆ The HVS was set at the monitoring location, with electricity supply connected and secured:
- ♦ HVS was calibrated before commencing the 1<sup>st</sup> measurement;
- ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- The airflow over time during sampling process was recorded by the HVS.

# 3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:

- ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- ◆ No furnace or incinerator flues was nearby;
- ◆ Airflow around the sampler was unrestricted; and
- Permission could be obtained to set up the samplers and gain access to the monitoring station.

### 3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

### 3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- ◆ The filter holder and area surrounding the filter were cleaned:
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 0.64-1.52m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6-1.7m³min⁻¹);

- ◆ The programmable timer was set for a sampling period of 24 hours, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

### 3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

### 3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.

### Noise

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level ( $L_{eq}$ ) in decibels dB(A).  $L_{Aeq(30min)}$  was used as the monitoring metric for the time period between 0700 -1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms<sup>-1</sup> or wind with gusts exceeding 10 ms<sup>-1</sup>. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms<sup>-1</sup>.

### 3.4. Monitoring Locations

### **Air Quality**

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favourable for monitoring and the access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tei Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Table 3.3 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
W-A1	Yau Ma Tei Catholic Primary School (Hoi Wang Road)
W-A6	Man Cheong Building

### **Noise**

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring stations are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

Table 3.4 Noise Monitoring Stations

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade
W-N18	Hydan Place	Façade
W-N25A	Prosperous Garden Block 1	Façade
W-P11	The Coronation Tower 1	Façade

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

**Impact** Duration **Sampling Parameter Frequency Monitoring** 1-hour continuous 1-hour TSP Dust 3 times per six days measurement 24-hour continuous Dust 24-hour TSP Once per six days sampling 30-minute continuous  $L_{eq 30 min}$ , Noise Once per week (0700 - 1900)measurement L<sub>10</sub> and L<sub>90</sub> as reference.

Table 3.5 Summary of Impact Monitoring Programme

3.6. Result Summary

### **Air Quality**

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are summarised in Table 3.6.

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source	
W-A1	Nearby traffic	
W-A6	Nearby traffic	

- 3.6.2. Air quality impact monitoring for the reporting month was carried out on 3, 9, 15, 21 and 27 March 2023.
- 3.6.3. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.7 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(µg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	52 - 68	319	500
W-A6	65 - 82	306	500

Table 3.8 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(μg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	27 - 144	167	260
W-A6	33 - 143	166	260

### **Noise**

3.6.4. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

Monitoring Station	Major Noise Source	
W-N1A	Nearby traffic	
W-N18	Nearby traffic	
W-N25A	Nearby traffic	
W-P11	Nearby traffic	

Table 3.9 Observation at Noise Monitoring Stations

- 3.6.5. The construction noise impact monitoring for the reporting month was carried out on 3, 9, 15, 21 and 27 March 2023.
- 3.6.6. The result for noise monitoring is summarized in Table 3.10. The measurement data are shown in Appendix M.

Time Monitoring Range, dB(A) **Parameter** Period location **Action Level** Limit Level#  $\mathbf{L}_{\mathsf{eq}}$  $L_{10}$  $L_{90}$ 70dB(A) or 65 W-N1A\* 61.1 - 66.856.3 - 60.359.1 - 64.3dB(A) during examination 69.2 - 72.770.9 - 75.166.3 - 66.8W-N18 Normal When one working Leq documented hour from 30min complaint is 0700-1900 received W-N25A 70.6 - 74.466.5 - 69.069.1 - 71.075dB(A)# W-P11 66.5 - 69.468.1 - 71.264.6 - 66.5

Table 3.10 Summary of Noise Monitoring Results

Remarks:

- 1. # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.
- 2. \*Examination was carried out at Yau Ma Tei Catholic Primary School from 2 March 2023 to 7 March 2023. The limit level of W-N1A on 3 March 2023 would be 65 dB(A).

### Waste management

3.6.7. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.11 Quantities of waste generated from the Project

		Quantity				
		Non-inert C&D Materials				
			Others, e.g.	Recy	ycled material	s
Reporting period	Inert C&D Materials (in 'tonnes)	Chemical Waste (in'000 Kg)	General Refuse disposed at Landfill (in 'tonnes)	Paper/card board (in '000 Kg)	Plastics (in '000 Kg)	Metals (in '000 Kg )
March 2023	18161.00	0.00	121.40	0.20	0.00	0.00

# 4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

Complaint Received via Project Hotline	Complaint Received via 1823 or from other government departments				
	go vormitono departmento				
Contractor notify ER, ET and IEC	ER notify Contractor, ET and IEC				
Contractor log complaint and date of receipt onto the complaint database. Contractor, ER and ET to conduct investigation of complaint					
If complaint is considered not valid	If complaint is found valid				
ET or ER to reply the complainant if necessary	Contractor to identify and implement remedial measures in consultation with the IEC, ET and ER.				
	The ER, ET and IEC to review the effectiveness of the Contractor's remedial measures and the updated situation; ET to undertake additional monitoring and audit to verify the situation if necessary, and oversee that circumstances leading to the complaint do not recur. ER to conduct				
	further inspection as necessary.				
If the complaint is referred by the EPD, the Contractor to prepare interim report on the status of the complaint investigation and follow-up actions stipulated above, including the details of the remedial measures and additional monitoring identified or already taken, for submission to EPD within the time frame assigned by the EPD					

The ET to record the details of the complaint, results of the investigation, subsequent actions taken to address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Event and Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. Six Action Levels of construction noise were triggered during the reporting month as documented complaints were received. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Level of 24-hour TSP and 1-hour TSP was recorded in the reporting month.
- 4.4. A total of seven environmental complaints were received in the reporting month. After investigation with Contractor, one complaint related to construction noise during restricted hour may pose potential compliance concern on CNP condition. Precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- 4.5. No notification of summon and prosecution was received in the reporting period.
- 4.6. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

### 5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, five (5) site inspections were carried out on 2, 9, 16, 23 and 30 March 2023, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 2, 16 and 30 March 2023.
- 5.2. One joint site inspection with IEC also undertaken on 9 March 2023. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

**Follow-up Status Date Environmental Observations** 1. Water pump should be provided to 1. Stagnant water had been removed at remove stagnant water in Zone C. Zone C. 2 March 2023 2. Cement bags at Zone D3 should be 2. Cement bags at Zone D3 had been covered with impervious sheeting. covered with impervious sheeting. Stockpile of cement bags should be 1. Stockpile of cement bags had been covered properly by tarpaulin in B3 covered properly by tarpaulin in B3 9 March 2023 and area under bridge P3. and area under bridge P3. 1. Cement mixing platform should be 1. Cement mixing platform had been 16 March 2023 covered on 3 sides and top at Zone G. removed at Zone G. Drip tray should be provided for 1. Chemicals had been removed by subchemical containers at P2 and Zone constructor at P2. Drip Chemical had been placed back on the drip tray at 23 March 2023 Zone B1. 2. Cement bags should be covered properly with impervious sheeting at 2. Cement bags had been removed at D3. 1. Cement bags need to be covered with 1. Cement bags had been covered with imprevious sheeting at Zone B3. impervious sheeting at Zone B3. 30 March 2023 Drip tray should be provided for 2. Empty of containers had been removed chemical containers at Zone D. at Zone D.

Table 5.1 Site Observations

- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.

### 6. FUTURE KEY ISSUES


6.1. The construction activities provided by Main Contractor in the next reporting month are:


### **Construction Activities to be undertaken**

- Construction of Lower Ventilation Duct Columns at Zone A
- Construction of roof slab at west of box culvert and Excavation and Lateral Support works to roof slab at east side of box culvert of Zone B
- Complete install hanger support for existing underground utilities under traffic deck, excavation to roof slab in Zones B, C and D including remaining roof slab construction at Zone C3 and 2nd stage pumping test at Zone D
- Underground Utilities diversion and D-wall construction at Zone B3
- Underground Utilities diversion, jet grouting, pre-boring works and D-wall construction at Zone
- Complete pipe piling and pre-boing works and commence D-wall construction at Zone G
- Works for reprovisioning of Gascogine Road Flyover at HKAA area: Construction of end span at P7L
- Bridge Works:
  - i. FT1- Construct Stich segment S2 between P2L & P3L and relocate FT1 to P5R
  - ii. FT2- Complete bridge deck construction for P2L
  - iii. Temporary street furniture works (parapet and noise barriers installation) and external PT works (deviator diaphragm construction)
- Continue Excavation and Lateral Support and construction works for pile caps and ground beams construction for middle / east /west foundation for F02 Noise Enclosure
- Erection of Y columns, side columns and main beams for Noise Enclosure F02 in Zone 3 (night works)
- Works at Zone 2 Noise Enclosure scheduled as the following:
  - i. Column A Excavation and Lateral Support works and pile cap construction
  - ii. Column E Complete backfilling following pile cap construction
  - iii. Columns G Socket H- piling works
  - iv. Column A1 Construct temporary RC pile cap and erect steel tower
  - v. Columns C Complete design and fabrication of steel footing and install steel footing
  - vi. Columns D Complete design and fabrication of steel footing and install steel footing
- Noise Enclosure steelworks fabrication at Fabrication Yard in Zhuhai, China
- Monitoring of instrumentation for all areas
- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.
- 6.3. The tentative schedule of regular construction noise, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.

### 7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 60<sup>th</sup> monthly EM&A Report presents the EM&A works undertaken during the period from 1 March 2023 to 31 March 2023 in accordance with the EM&A Manual and the requirement under EP- 457/2013/D and FEP-03/457/2013/D.
- 7.2. Six Action Levels of construction noise were triggered during the reporting month as documented complaints were received. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Level of 24-hour TSP and 1-hour TSP was recorded in the reporting month.
- 7.3. A total of seven environmental complaints were received in the reporting month. After investigation with Contractor, one complaint related to construction noise during restricted hour may pose potential compliance concern on CNP condition. Precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- 7.4. No notification of summons or prosecution was received in the reporting month.
- 7.5. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

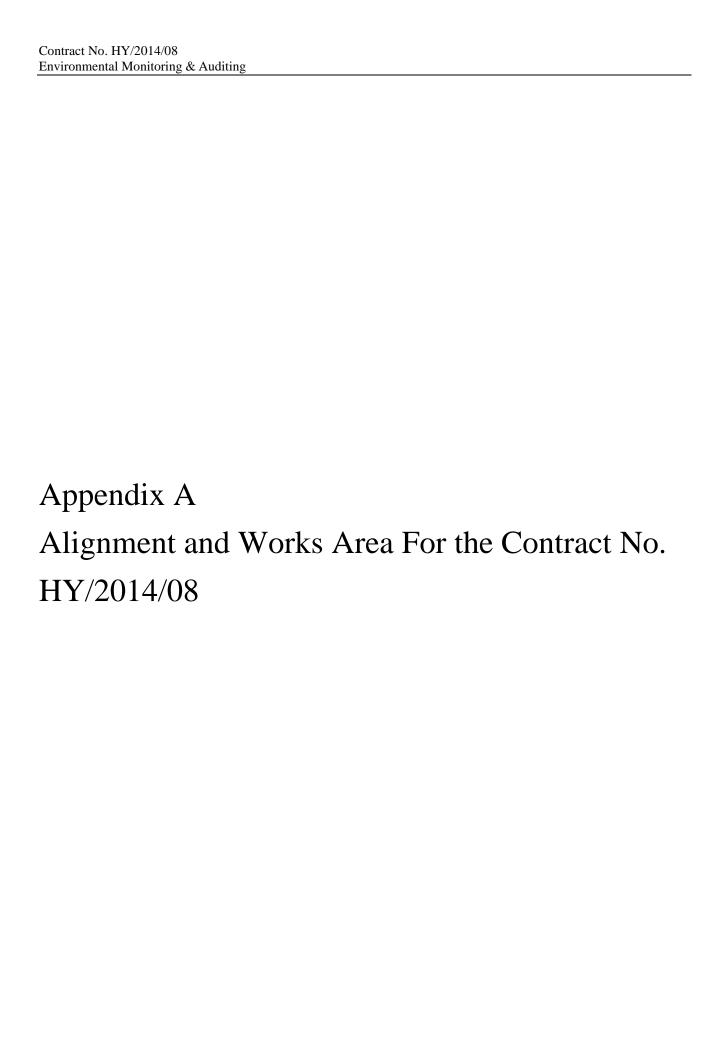

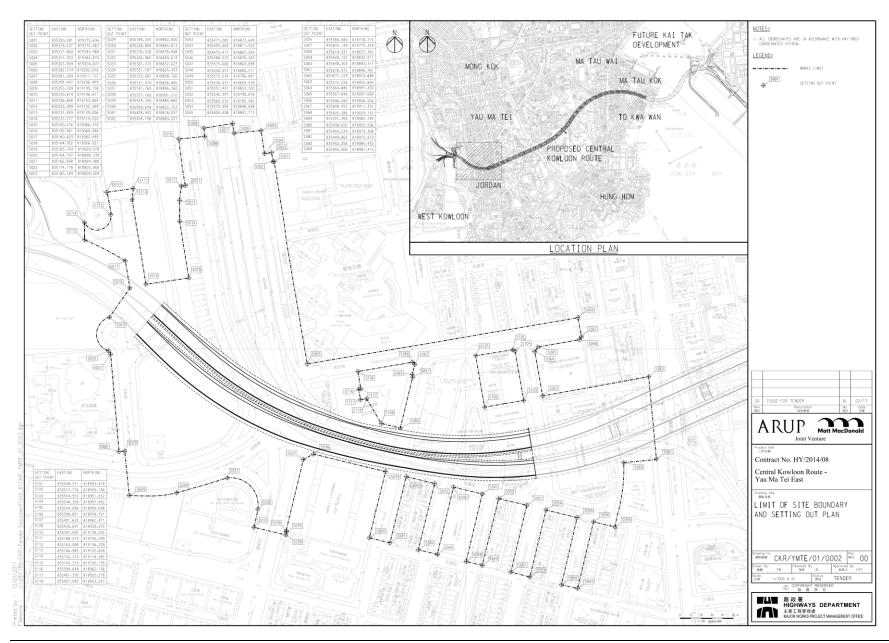





# Appendix B Construction Programme



Contract No. HY/2014/08 Environmental Monitoring & Auditing
Environmental Monitoring & Auditing
Appendix C
Project Organization Chart
J

## Project O-Chart

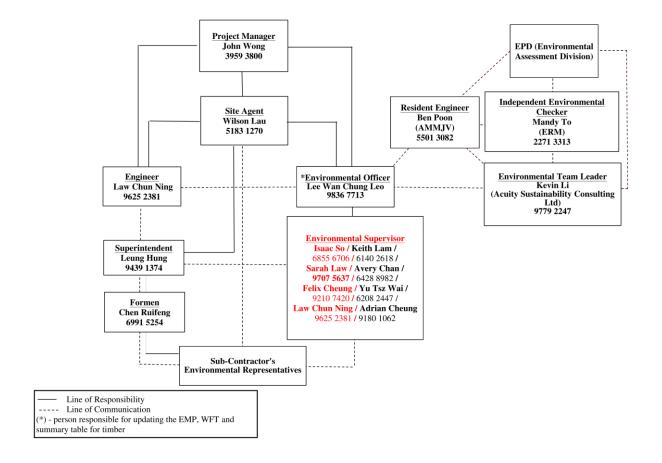

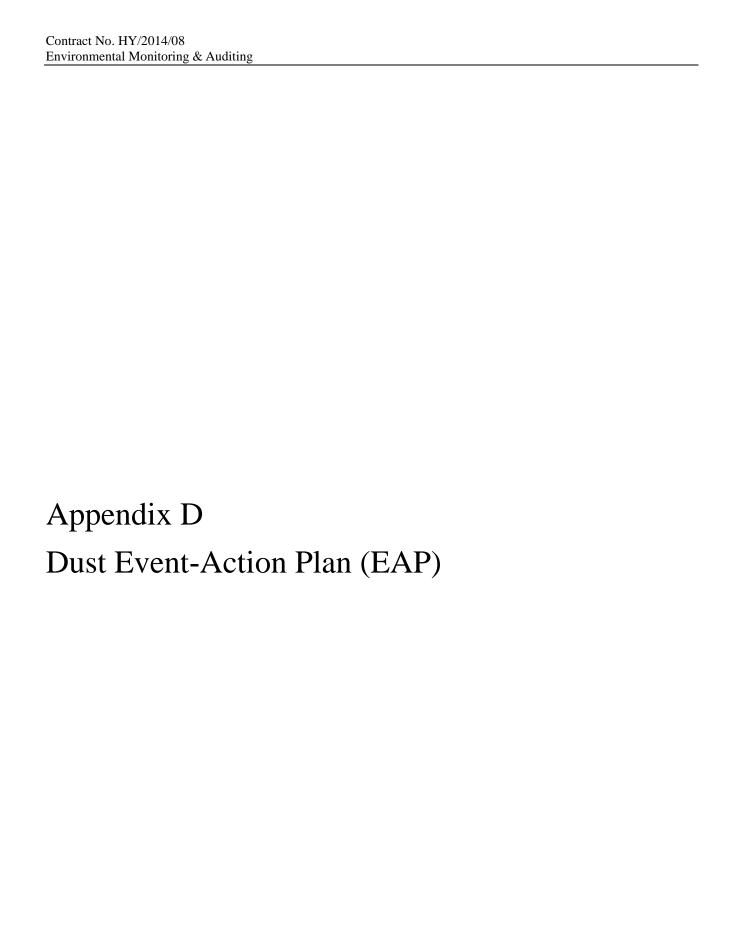

EVENT	ACTION						
EVENI	ET	IEC	ER	CONTRACTOR			
ACTION LEVEL							
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures;     Inform IEC and ER;     Repeat measurement to confirm finding;     Increase monitoring frequency to daily.	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	1. Notify Contractor.	Rectify any unacceptable practice;     Amend working methods if appropriate.			
2.Exceedance for two or more consecutive samples	<ol> <li>Identify source;</li> <li>Inform IEC and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	Confirm receipt of notification of failure in writing;     Notify Contractor;     Ensure remedial measures properly implemented.	<ol> <li>Submit proposals for remedial to ER within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>			
LIMIT LEVEL							
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures;     Inform ER, Contractor and	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> </ol>	Confirm receipt of     notification of failure in     writing;     Notify Contractor;	Take immediate action to avoid further exceedance;     Submit proposals for remedial actions to IEC			


EVENT	ACTION			
EVENI	ET	IEC	ER	CONTRACTOR
	<ul> <li>EPD;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ul>	<ul> <li>3. Discuss with ET and Contractor on possible remedial measures;</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>5. Supervise implementation of remedial measures.</li> </ul>	3. Ensure remedial measures properly implemented.	within 3 working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.
2.Exceedance for two or more consecutive samples	<ol> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

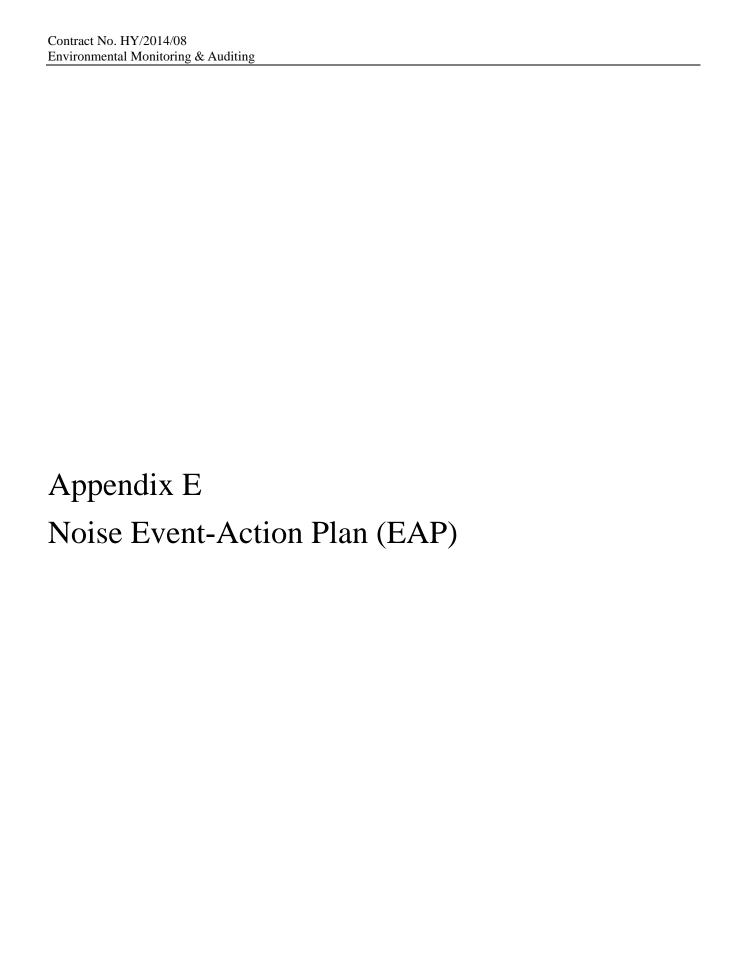

EVENT		ACTIO	ON	
	ET	IEC	ER	CONTRACTOR
Action Level	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Notify IEC and Contractor;</li> <li>Report the results of investigation to the IEC, ER and Contractor;</li> <li>Discuss with the Contractor and formulate remedial measures;</li> <li>Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol> <li>Review the analysed results submitted by the ET;</li> <li>Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures are properly implemented</li> </ol>	Submit noise mitigation proposals to IEC;     Implement noise mitigation proposals.
Limit Level	<ol> <li>Identify source;</li> <li>Inform IEC, ER, EPD and Contractor;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Inform IEC, ER and EPD the causes and actions taken for the exceedances;</li> <li>Assess effectiveness of Contractor's remedial actions</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

EVENT	ACTION							
	ET	IEC	ER	CONTRACTOR				
	and keep IEC, EPD and ER informed of the results;		abated.					
	8. If exceedance stops, cease additional monitoring.							

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative



Appendix F
Environmental Mitigation Implementation
Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Constru	ction Dust Impact				
\$4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented
S4.3.10	D2	<ul> <li>Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m² to achieve the dust removal efficiency.</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	• Implemented
S4.3.10	D3	<ul> <li>Proper watering at exposed spoil should be undertaken throughout the construction phase;</li> <li>Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading;</li> <li>Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads;</li> <li>A stockpile of dusty material should not be</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		extended beyond the pedestrian barriers, fencing or traffic cones;  The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle.  Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores;  When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;  The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials;  Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>continuously;</li> <li>Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet;</li> <li>Any skip hoist for material transport should be totally enclosed by impervious sheeting;</li> <li>Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides;</li> <li>Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system</li> <li>Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies.</li> </ul>						
S4.3.10	D6	Implement regular dust monitoring under EM&A programme during the construction stage.	Monitoring of dust impact	Contractor	Selected rep. dust monitoring station	Construction stage	• TM-EIA	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	<ul> <li>Implement the following good site practices:</li> <li>Only well-maintained plant should be operated onsite and plant should be serviced regularly during the construction programme;</li> <li>Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;</li> <li>Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works;</li> <li>Mobile plant should be sited as far away from NSRs as possible and practicable;</li> <li>Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities.</li> </ul>	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
S5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	Annex 5, TM- EIAO	Implemented
\$5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all construction	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM- EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM- EIAO	Implemented
S5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

Water Quality (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.1	W1	In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following:  Construction Runoff  • At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction;  • The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates;  • The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m3/s a sedimentation basin of 30 m3 would be required and for a flow rate of 0.5 m3/s the basin would be 150 m3. The detailed design of the sand/silt traps shall be undertaken by the contractor prior to the commencement of construction;  • All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means;  • The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows;  • All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas;  • Measures should be taken to minimize the ingress of site drainage into excavations. If the excavation						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;  Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;  Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers;  Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes;  All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing facilities should be provided at every construction						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains;  Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain;  Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts;  All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby;  Adopt best management practices;  All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to January) as far as practicable.						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S6.9.1.2	W2	<ul> <li>Cut-&amp;-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to January) as far as practicable.</li> <li>Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge;</li> <li>The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater;</li> <li>Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.</li> </ul>	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	Water     Pollution     Control     Ordinance     ProPECC PN     1/94     TM-DSS     TM-EIAO	• Implemented
\$6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water     Pollution     Control     Ordinance     TM-DSS	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		responsible for appropriate disposal and maintenance.						
S6.9.1.5	W4	<ul> <li>No direct discharge of groundwater from contaminated areas should be adopted.</li> <li>A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly recharged into the ground.</li> <li>If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an</li> </ul>	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	Water     Pollution     Control     Ordinance     TM-DSS     TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers.  • If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater to be recharged) to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol interceptor.						
\$6.9.1.6		Accidental Spillage  In order to prevent accidental spillage of chemicals, the following is recommended:	To minimize water quality impact from accidental	Contractor	All construction site where practicable	Construction stage	Water     Pollution     Control     Ordinance	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains;  The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings.  Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation.	spillage				• ProPECC PN 1/94 • TM-EIAO • TM-DSS	
			Waste Manage	ement (Construction	Waste)			
S7.4.1	WM1	Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM2	batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.	Good site	Contractor	All	Construction stage	• Land	• Implemented
57.5.1	WIVI2	<ul> <li>Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement;</li> <li>Carry out on-site sorting;</li> <li>Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate;</li> <li>Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible;</li> <li>Implement a trip-ticket system for each works contract to ensure that the disposal of C&amp;D materials are properly documented and verified; and</li> </ul>	practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	construction sites	Construction stage	Land     (Miscellaneo     us Provisions)     Ordinance     Waste     Disposal     Ordinance     ETWB TCW     No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction.						
\$7.5.1	WM3	<ul> <li>Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&amp;D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage;</li> <li>The Contractor should recycle as much of the C&amp;D materials as possible on-site. Public fill and C&amp;D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.</li> </ul>	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land     (Miscellaneo     us Provisions)     Ordinance     Waste     Disposal     Ordinance     ETWB TCW     No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM5	<ul> <li>All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location;</li> <li>All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash;</li> <li>Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the excess materials shall never be dumped into the sea except at the approved locations;</li> <li>Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action.</li> <li>The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations and copies of such records shall be submitted to the engineers;</li> <li>The Contractors shall comply with the conditions in the dumping licence.</li> </ul>	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material;</li> <li>The material shall be placed into the disposal pit by bottom dumping;</li> <li>Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site;</li> <li>Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site.</li> <li>For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal.</li> </ul>						
S7.5.1	WM6	<ul> <li>Chemical Waste</li> <li>Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in</li> </ul>	Control the chemical waste and ensure proper storage,	Contractor	All construction sites	Construction stage	• Waste Disposal (Chemical Waste)	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes;  Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation;  The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated;  Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.	handling and disposal				(General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM7	<ul> <li>General Refuse</li> <li>General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes;</li> <li>A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law.</li> <li>Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible;</li> <li>Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor.</li> </ul>	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste     Disposal     Ordinance	• Implemented
		sometime should be considered by the contractor.	Land Contamin	ation				
S8.9 & Appendix 8.4	LC2	Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant.      The excavated contaminated soils would be stockpiled at designated area on site and covered by sheet to prevent dispersion of contamination	The contaminated soil will be excavated for on-site reuse	Contractor	РВН4	Prior to commencement of construction works within the contaminated area	Practice     Guide (PG)     for     Investigation     and     Remediation     of     Contaminate     d Land	• Implemented

EIA Ref.	EM&A Log Ref.	Reco	mmended Mitigat	tion Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S8.9 &	LC3	during stockpiling.  The Contractor should pay attention to the selection of suitable groundwater lowering schemes and discharge points if the groundwater table is higher than the contaminated soils during excavation. The Contractor should also obtain a valid Water Pollution Control Ordinance (WPCO) discharge licence from EPD where applicable.							Guidance     Notes for     Contaminate     d Land     Assessment     and     Remediation     Guidance     Manual for	
Appendix 8.4	LCS	Following completion of the excavation to the specified depth, at least one sample from the base of the excavation and four samples evenly distributed along the boundary of the excavation shall be taken for a closure assessment testing. The acceptance criterion is shown below:    Locations   Testing   Acceptance   Criteria						Use of Risk- Based Remediation Goals (RBRGs) for Contaminate	Implemented	
								d Land Management		

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
Appendix 8.4	LC4	excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist.  A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No						Implemented
		construction/development works shall be carried out prior to the endorsement of the RR by EPD.		Uses and the Life				
	T			Hazard to Life	T	T 2	1	,
\$9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous     Goods     Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	Dangerous     Goods     Ordinance	• N/A
S9.6,	Н3	The explosives delivery trucks should be approved by	To comply with	Contractor	-	Construction stage	<ul> <li>Dangerous</li> </ul>	• N/A
para.8		Mines Division and should meet the regulatory requirements for transport of explosives.	the requirements for approval of an explosives				Goods Ordinance	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			delivery vehicle					
S9.10, para.7 and S9.18	H4	Blast cover should be provided for shaft at HMT, and kept closed during blasting.  Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	Н7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous     Goods     Ordinance	• N/A
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.						
S9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
			Lan	dscape & Visual				
S10.10.1 Table 10.11	LV3	Good Site Management     Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent landscape areas and vegetation, and to create a neat and tidy visual appearance.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance.						
S10.10.1 Table 10.11	LV4	Screen Hoarding     Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	Lighting Control during Construction     All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV6	Erosion Control     The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation  • Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval in due course in accordance with ETWB TC no. 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	• 'Guidelines for Tree Risk Management and Assessment Arrangement on an Area Basis and on a Tree Basis', Greening,	• Implemented


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1 Table 10.11	LV8	Tree Transplantation  • For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	Landscape and Tree Management (GLTM) Section, DEVB  Latest recommende d horticultural practices from GLTM Section, DEVB  ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							2/2004	
S10.10.1 Table 10.11	LV9	<ul> <li>Compensatory Planting</li> <li>For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006.</li> <li>Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process.</li> </ul>	Minimize visual impact and also enhance landscape	Contractor	Within Project site	Construction stage	ETWB TCW 3/2006     Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB     ETWB TCW 2/2004	• N/A
			Cultural Heritage	Impact (Construct	on Phase)			

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures  The contractor should be alerted during the	Objectives of the Recommende d Measures & Main Concerns to address To preserve any	Implementation Agent  Contractor	Location / Timing During	Implementation Stage  Construction stage	Requirements and/ or standards to be achieved  • AMOs	Implementation Status  • Implemented
		construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	cultural heritage items which may be removed and damaged by the excavation		construction works for cut and cover tunnels		requirements	·
S12.6.1	СНЗ	<ul> <li>Protective covering should be provided for the buildings in the form of plastic sheeting;</li> <li>Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding;</li> <li>An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams;</li> <li>The AAA settlement and tilting limit should be 6/8/10 mm and1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.</li> </ul>						
\$12.6.1		<ul> <li>Adopting diaphragm wall construction method;</li> <li>Grout curtain should be provided in front of the building;</li> <li>Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table;</li> <li>the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;.</li> <li>Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment     EIAO-TM Annex 10 and Annex 19     AMO Proposed Vibration Limits	• Implemented
S12.6.1 Table 12.2		<ul> <li>The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment</li> <li>Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment.</li> </ul>	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR- 02)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment     EIAO-TM Annex 10 and Annex 19     AMO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status		
							Proposed Vibration Limits			
	EM&A Project									
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented		
S13.2-13.4	EM2	<ul> <li>An Environmental Team needs to be employed as per the EM&amp;A Manual;</li> <li>Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures;</li> <li>An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&amp;A Manual are fully complied with.</li> </ul>	Perform environmental monitoring & auditing	Highways Department/ Contractor	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented		

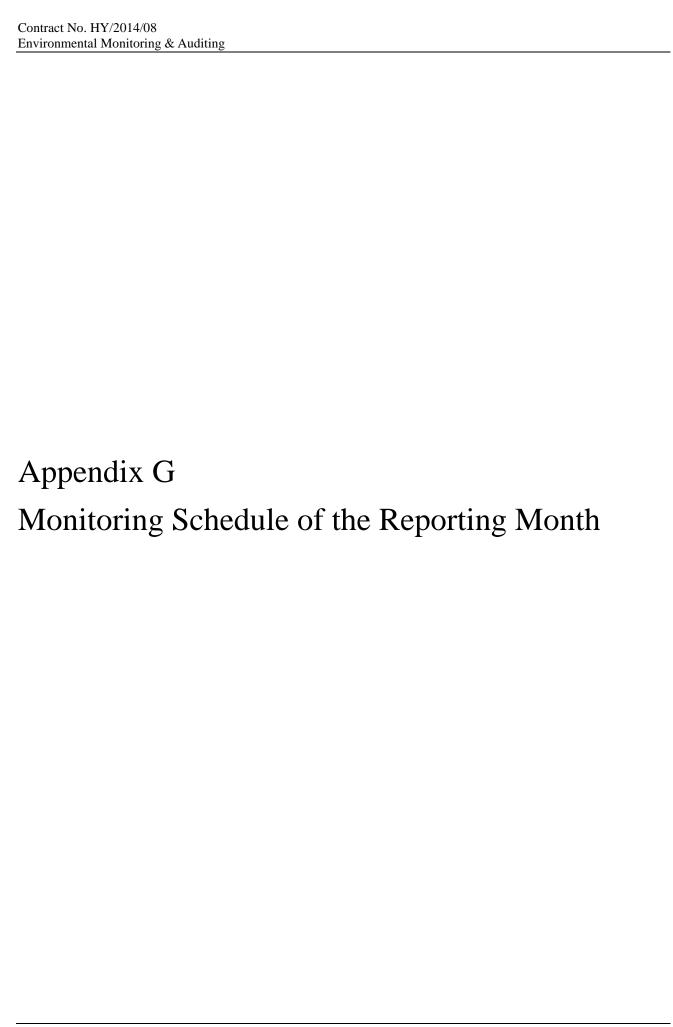

		Impa	act Monitoring Schedule for	<b>УМТЕ</b>		
			Mar-23			
Sun	Mon	Tue	Wed		Fri	Sat
			1		Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A	4
5	6	7	8	9 Impact	10	11
				Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A		
12	13	14		16	17	18
			Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A			
19	20	21	22	23	24	25
		Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A				
26	27	28	29	30	31	
	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A					

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix H
Calibration Certificates
(Air Monitoring)







# Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

27-Mar-22 3-Apr-22

Next Verification Test Date: 4-Apr-23 Unit-under-Test- Model No. Sibata LD-5R 0Z4545 Unit-under-Test Serial No. Our Report Refrence No. RPT-22-HVS-0006

Standard Equipment Information				
Verification Equipment Type	Tis	sch's TSP	Tish HVS	
vernication Equipment Type		HVS	Calibrator	
Standard Equipment Model No.	т	E-5170X	TE-5028A	
Equipment serial no.	MFC	1049	3702	
Last Calibration Date	22	2-Mar-22	3-Aug-21	
Next Calibration Date	2:	1-Jun-22	4-Aug-22	

Verification	Date		Time		K-Factor	tor Counts/ Minute (R)		TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	27/3/2022	4945.81	4949.09	196.80	0.00078	64	12661	R220486/1	50
2	27/3/2022	4949.09	4952.83	224.40	0.00078	68	15259	R220486/2	53
3	27/3/2022	4952.83	4956.42	215.40	0.00075	63	13498	R220486/3	47
4	3/4/2022	4991.80	4995.40	216.00	0.00047	48	10296	R220538/1	22
5	3/4/2022	4995.40	4998.79	203.40	0.00045	52	10577	R220538/2	23
6	3/4/2022	4998.79	5002.26	208.20	0.00065	57	11937	R220538/3	37
					0.00065				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

By Linear Regression of y on x:

1.7194 slope, mh= intercept,ch= -61.9131 \*Correlation Coefficient,R= 0.9829


Verification Test Result: Strong Correlation, Results were accepted.

 $\ensuremath{^{*}}$  If the Correlation Coefficient, R is <0.5. Checking and Re-

verification are required.

Verified By:

Date: <u>14-04-2022</u>

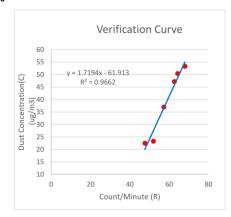









# Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Mar-22 to 3-Apr-22

Next Verification Test Date: 4-Apr-23
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 992820
Our Report Refrence No. RPT-22-HVS-0004

Standard Equipment Information		
Verification Equipment Type	Tisch's TS	P Tish HVS
vernication Equipment Type	HVS	Calibrator
Standard Equipment Model No.	TE-5170)	TE-5028A
Equipment serial no.	MFC 1049	3702
Last Calibration Date	22-Mar-2	2 3-Aug-21
Next Calibration Date	21-Jun-22	2 4-Aug-22

Verification	Date		Time		K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	27/3/2022	4945.81	4949.09	196.80	0.00083	61	12005	R220486/1	50
2	27/3/2022	4949.09	4952.83	224.40	0.00082	65	14586	R220486/2	53
3	27/3/2022	4952.83	4956.42	215.40	0.00081	58	12493	R220486/3	47
4	3/4/2022	4991.80	4995.40	216.00	0.00047	48	10296	R220538/1	22
5	3/4/2022	4995.40	4998.79	203.40	0.00047	50	10102	R220538/2	23
6	3/4/2022	4998.79	5002.26	208.20	0.00067	56	11590	R220538/3	37
					0.00068				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

0.7

By Linear Regression of y on x:

slope, mh= 2.0047 intercept,ch= -73.6384


\*Correlation Coefficient,R= 0.9763

Verification Test Result: <u>Strong Correlation, Results were accepted.</u>

 $\mbox{\ensuremath{^{\bullet}}}$  If the Correlation Coefficient, R is <0.5. Checking and Reverification are required.

Verified By:

Date: 14-04-2022

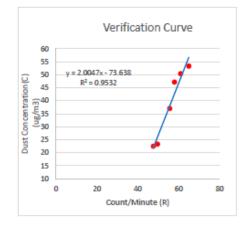







Tel.: (852) 2698 6833

# PC-3A(E) K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Mar-22 to 3-Apr-22

 Next Verification Test Date:
 4-Apr-23

 Unit-under-Test- Model No.
 PC-3A(E)

 Unit-under-Test Serial No.
 JC2002224

 Our Report Refrence No.
 RPT-22-HVS-0010

Standard Equipment Information			
Verification Equipment Type		Tisch's TSP	Tish HVS
verification Equipment Type		HVS	Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028A
Equipment serial no.	MFC	1049	3702
Last Calibration Date		22-Mar-22	3-Aug-21
Next Calibration Date		21-Jun-22	4-Aug-22

Verification	Date		Time		K-Factor Counts/ Minute (R)		Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	27/3/2022	4945.81	4949.09	196.80	0.00082	62	12136	R220486/1	50
2	27/3/2022	4949.09	4952.83	224.40	0.00082	65	14661	R220486/2	53
3	27/3/2022	4952.83	4956.42	215.40	0.00078	61	13068	R220486/3	47
4	3/4/2022	4991.80	4995.40	216.00	0.00048	47	10080	R220538/1	22
5	3/4/2022	4995.40	4998.79	203.40	0.00042	55	11187	R220538/2	23
6	3/4/2022	4998.79	5002.26	208.20	0.00064	58	12076	R220538/3	37
	•				0.00066		•		

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

0.7

By Linear Regression of y on x:

slope, mh= 1.9032 intercept,ch= -71.2168 \*Correlation Coefficient,R= 0.9103

Verification Test Result: <u>Strong Correlation, Results were accepted.</u>


 $\ensuremath{^{*}}$  If the Correlation Coefficient, R is <0.5. Checking and Re-

verification are required.

Verified By:

Field Supervisor

Date: <u>14-04-2022</u>

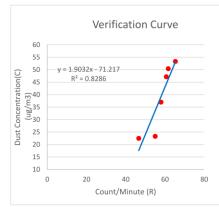







Tel.: (852) 2698 6833 Fax: (852) 2698 9383

# PC-3A(E) K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Mar-22 to 3-Apr-22

 Next Verification Test Date:
 4-Apr-23

 Unit-under-Test- Model No.
 PC-3A(E)

 Unit-under-Test Serial No.
 JC2002225

 Our Report Refrence No.
 RPT-22-HVS-0011

Standard Equipment Information		
Verification Equipment Type	Tisch's	TSP Tish HVS
Verification Equipment Type	HVS	Calibrator
Standard Equipment Model No.	TE-517	0X TE-5028A
Equipment serial no.	MFC 1049	3702
Last Calibration Date	22-Mar	-22 3-Aug-21
Next Calibration Date	21-Jun-	22 4-Aug-22

Verification	Date	Time		K-Factor	K-Factor Counts/ Minute (R)		TSP Sample	Dust Concentration (ug/m3), (C)	
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	27/3/2022	4945.81	4949.09	196.80	0.00078	64	12661	R220486/1	50
2	27/3/2022	4949.09	4952.83	224.40	0.00080	67	14960	R220486/2	53
3	27/3/2022	4952.83	4956.42	215.40	0.00076	62	13427	R220486/3	47
4	3/4/2022	4991.80	4995.40	216.00	0.00042	53	11448	R220538/1	22
5	3/4/2022	4995.40	4998.79	203.40	0.00042	55	11187	R220538/2	23
6	3/4/2022	4998.79	5002.26	208.20	0.00064	58	12006	R220538/3	37
	•	•			0.00064				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

0.6

By Linear Regression of y on x:

slope, mh= 2.4515 intercept,ch= -107.7256 \*Correlation Coefficient,R= 0.9802

Verification Test Result: Strong Correlation, Results were accepted.


 $\ensuremath{^{*}}$  If the Correlation Coefficient, R is <0.5. Checking and Re-

verification are required.

Verified By:

Field Supervisor

Date: <u>14-04-2022</u>

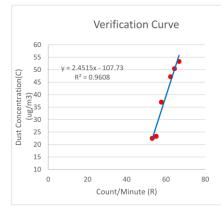



RECALIBRATION DUE DATE:

June 28, 2023

# Certificate of Calibration

Calibration Certification Information

Cal. Date: June 28, 2022

Rootsmeter 5/N: 438320

Ta: 296 Pa: 755.1

> ΔH (in H2O)

°K mm Hg

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 3465

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	
1	1	2	1	1.4290	3.2	
2	3	4	1	1.0130	6.4	

3	5	6	1	0.9050	7.9	5.00
4	7	8	1	0.8590	8.8	5.50
5	9	10	1	0.7110	12.8	8.00
		Data	Tabulatio	n		
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right)} \left(\frac{T}{T}\right)$	std )	Va	Qa (x-axis)	√∆H(Ta/Pa)
0.9961	0.6970	1.4144		0.9958	0.6968	0.8854

(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)
0.9961	0.6970	1.4144	0.9958	0.6968	0.8854
0.9918	0.9791	2.0003	0.9915	0.9788	1.2522
0.9899	1.0938	2.2364	0.9895	1.0934	1.4000
0.9887	1.1509	2.3456	0.9883	1.1506	1.4683
0.9834	1.3831	2.8289	0.9830	1.3826	1.7708
kee avore	m=	2.05924		m=	1.28946
QSTD	b=	-0.01929	QA [	b=	-0.01207
	r=	0.99998	-	r=	0.99998

Calculation	ons
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va= ΔVol((Pa-ΔP)/Pa)
Qstd= Vstd/\DeltaTime	Qa= Va/ΔTime
For subsequent flow r	ate calculations:
Qstd= $1/m\left(\left(\frac{Pa}{2}\Delta H\left(\frac{Pa}{Patd}\right)\left(\frac{Tstd}{Ta}\right)\right) \cdot b\right)$	Qa= 1/m(( √ΔH(Ta/Pa) )-b

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
	er manometer reading (mm Hg)
Ta: actual abs	olute temperature ("K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

## RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com TOLL FREE: (877)263-7610 FAX: (513)467-9009





#### Site Information

Location:	Man Cheong Building	Site ID:	W-A6	Date:	02-Mar-2023
Serial No:	1050	Model:	TE-5170X	Operator:	Andy Li

#### **Ambient Condition**

Actual Pressure during Calibration (Pa)	767.0	Actual Temperature during	202.0
(mm Hg):	767.9	Calibration (T <sub>a</sub> ) (deg K):	293.0

#### **Calibration Orifice**

Model:	TE-5025A	Slope (m <sub>c</sub> ):	2.05924
Serial No.:	3465	Intercept (b <sub>c</sub> ):	-0.01929
Calibration Due Date:	28-Jun-23	Corr. Coeff:	0.99998

#### **Calibration Data**

Plate or	∆H <sub>2</sub> O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m³/min)	(chart)	(corrected)
18	12.00	1.715	63.0	63.86
13	9.50	1.527	58.0	58.80
10	7.10	1.321	51.0	51.70
7	4.60	1.065	43.0	43.59
5	3.10	0.876	37.0	37.51

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

31.7825 Corr. Coeff= 0.9995

#### Calculations


Qa =  $1/m_c^*[Sqrt (\Delta H_2O^*(P_a/P_{Std})^*(T_{Std}/T_a))-b_c]$ 

 $IC = I*(Sqrt (P_a/P_{Std})*(T_{Std}/T_a))$ 

Qa = actual flow rate IC = corrected chart response I = actual chart response m<sub>c</sub> = calibrator slope b<sub>c</sub> = calibrator intercept

m = sampler slope b = sampler intercept T<sub>Std</sub> = 298 deg K P<sub>Std</sub> = 760 mm Hg

T<sub>a</sub> = actual temperature during calibration (deg K) P<sub>a</sub> = actual pressure during calibration (mm Hg)

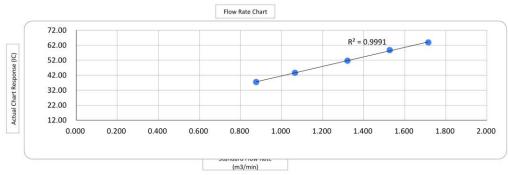

02-Mar-2023 Checked by: Date:





#### Site Information

Location:	YMT Catholic Primary School	Site ID:	W-A1	Date:	02-Mar-2023	
Serial No:	1084	Model:	TE-5170X	Operator:	Andy Li	

### **Ambient Condition**

Actual Pressure during Calibration (Pa)	767.9	Actual Temperature during	293.0
(mm Hg):	767.9	Calibration (T <sub>a</sub> ) (deg K):	295.0

#### **Calibration Orifice**

Model:	TE-5025A	Slope (m <sub>c</sub> ):	2.05924
Serial No.:	3465	Intercept (b <sub>c</sub> ):	-0.01929
Calibration Due Date:	28-Jun-23	Corr. Coeff:	0.99998

#### **Calibration Data**

Plate or	∆H <sub>2</sub> O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m³/min)	(chart)	(corrected)
18	11.80	1.700	64.0	64.88
13	9.90	1.558	59.0	59.81
10	6.90	1.302	50.0	50.69
7	4.90	1.099	44.0	44.60
5	3.20	0.890	36.0	36.49

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	34.5951	b= 5.9732	Corr. Coeff=	0.9994

#### Calculations


Qa =  $1/m_c^* [Sqrt (\Delta H_2O^*(P_a/P_{Std})^*(T_{Std}/T_a)) - b_c]$ 

 $IC = I*(Sqrt (P_a/P_{Std})*(T_{Std}/T_a))$ 

Qa = actual flow rate
IC = corrected chart response
I = actual chart response
m<sub>c</sub> = calibrator slope
b<sub>c</sub> = calibrator intercept

m = sampler slope b = sampler intercept T<sub>Std</sub> = 298 deg K P<sub>Std</sub> = 760 mm Hg

 $T_a$  = actual temperature during calibration (deg K)  $P_a$  = actual pressure during calibration (mm Hg)

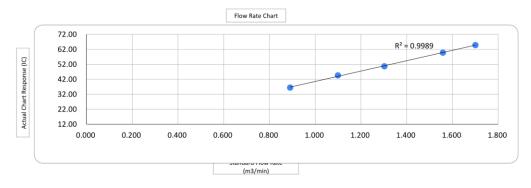

Checked by: \_\_\_\_\_ Date: \_\_\_\_\_02-Mar-2023





#### Site Information

Location:	Man Cheong Building	Site ID:	W-A6	Date:	16-Mar-2023			
Serial No:	1050	Model:	TE-5170X	Operator:	Andy Li			

#### **Ambient Condition**

Actual Pressure during Calibration (Pa)	763.9	Actual Temperature during	295.1
(mm Hg):	763.9	Calibration (T <sub>a</sub> ) (deg K):	295.1

#### **Calibration Orifice**

Model:	TE-5025A	Slope (m <sub>c</sub> ):	2.05924
Serial No.:	3465	Intercept (b <sub>c</sub> ):	-0.01929
Calibration Due Date:	28-Jun-23	Corr. Coeff:	0.99998

#### **Calibration Data**

Plate or	∆H <sub>2</sub> O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m³/min)	(chart)	(corrected)
18	12.30	1.725	64.0	64.48
13	9.30	1.501	56.0	56.42
10	7.20	1.322	51.0	51.38
7	4.50	1.047	42.0	42.31
5	3.00	0.857	36.0	36.27

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

Corr. Coeff= 32.2082 8.6061

#### Calculations


Qa =  $1/m_c^*[Sqrt (\Delta H_2O^*(P_a/P_{Std})^*(T_{Std}/T_a))-b_c]$ 

 $IC = I*(Sqrt (P_a/P_{Std})*(T_{Std}/T_a))$ 

Qa = actual flow rate IC = corrected chart response I = actual chart response

m<sub>c</sub> = calibrator slope b<sub>c</sub> = calibrator intercept m = sampler slope b = sampler intercept T<sub>Std</sub> = 298 deg K P<sub>Std</sub> = 760 mm Hg

T<sub>a</sub> = actual temperature during calibration (deg K) P<sub>a</sub> = actual pressure during calibration (mm Hg)

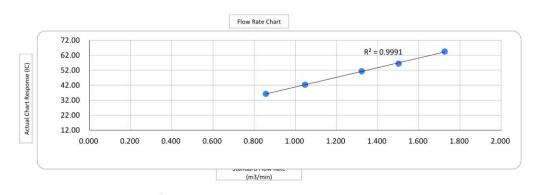

Checked by:\_ 16-Mar-2023 Date:





#### Site Information

Otto information						
Location:	YMT Catholic Primary School	Site ID:	W-A1	Date:	16-Mar-2023	
Serial No:	1084	Model:	TE-5170X	Operator:	Andy Li	

### **Ambient Condition**

Actual Pressure during Calibration (Pa)	763.9	Actual Temperature during	205.1
(mm Hg):	763.9	Calibration (T <sub>a</sub> ) (deg K):	295.1

#### **Calibration Orifice**

Model:	TE-5025A	Slope (m <sub>c</sub> ):	2.05924
Serial No.:	3465	Intercept (b <sub>c</sub> ):	-0.01929
Calibration Due Date:	28-Jun-23	Corr. Coeff:	0.99998

#### **Calibration Data**

Plate or	∆H <sub>2</sub> O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m³/min)	(chart)	(corrected)
18	11.70	1.683	62.0	62.46
13	9.70	1.533	57.0	57.43
10	6.80	1.285	49.0	49.37
7	5.00	1.103	44.0	44.33
5	3.20	0.885	37.0	37.28

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	31.3189	b= 9.5263	Corr. Coeff=	0.9996


#### Calculations

$$\begin{split} Qa &= 1/m_c * [Sqrt \ (\Delta H_2 O * (P_a/P_{Std}) * (T_{Std}/T_a)) - b_c] \\ IC &= I * (Sqrt \ (P_a/P_{Std}) * (T_{Std}/T_a)) \end{split}$$

 $\begin{aligned} &Qa = \text{actual flow rate} \\ &IC = \text{corrected chart response} \\ &I = \text{actual chart response} \\ &m_c = \text{calibrator slope} \\ &b_c = \text{calibrator intercept} \end{aligned}$ 

m = sampler slope b = sampler intercept T<sub>Std</sub> = 298 deg K P<sub>Std</sub> = 760 mm Hg

 $T_a$  = actual temperature during calibration (deg K)  $P_a$  = actual pressure during calibration (mm Hg)

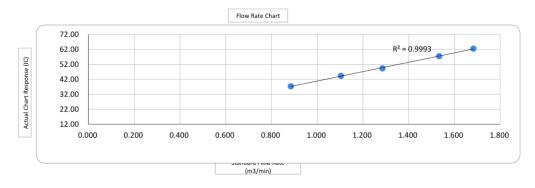

Checked by: \_\_\_\_\_ Date: \_\_\_\_16-Mar-2023

Environmental Monitoring & Auditing	
Appendix I	
Appendix I	
C = 1.1  A :  C = A : C :  A :  A : C :  A = A : C :  A :  A : C :  A :  A : C :  A :	
I Olibrotion I ortitiontog / Noigo	
Cambration Certificates (Noise)	
Calibration Certificates (Noise)	
Cambration Certificates (Noise)	
Cambration Certificates (Noise)	
Candration Certificates (Noise)	
Cambration Certificates (Noise)	
Canoration Certificates (Noise)	
Cambration Certificates (Noise)	
Canoration Certificates (Noise)	
Cambration Certificates (Noise)	
Canoration Certificates (Noise)	
Cambration Certificates (Noise)	
Cantilation Certificates (Noise)	
Cantilation Certificates (Noise)	
Canoration Certificates (Noise)	
Cambration Certificates (Noise)	
Cambration Certificates (Noise)	
Cambration Certificates (Noise)	
Canoration Certificates (Noise)	
Cambration Certificates (Noise)	
Canoration Certificates (Noise)	
Cambration Certificates (Noise)	

Contract No. HY/2014/08



# Certificate of Calibration

for

Description: Sound Level Meter

Manufacturer: NTi Audio

 Type No.:
 XL2 (Serial No.: A2A-13661-E0)

 Microphone:
 ACO 7052 (Serial No.:68914)

Preamplifier: NTi Audio MA220 (M2211) (Serial No.:6282)

Submitted by:

Customer: Acuity Sustainability Consulting Limited

Address: Unit E, 12/F., Ford Glory Plaza,

Nos. 37-39 Wing Hong Street,

Cheung Sha Wan, Kowloon, Hong Kong

Upon receipt for calibration, the instrument was found to be:

Within (31.5Hz – 8kHz)

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

 The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 20 August 2022

Date of calibration: 22 August 2022

Date of NEXT calibration: 21 August 2023

Calibrated by: \_\_\_\_\_\_ Calibration Technician

22 /

Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue: 22 August 2022

Certificate No.: APJ22-071-CC001

(A+A) \*L

Page 1 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946

# Acoustics and Air Testing Laboratory Co. Ltd.

#### 1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

#### 2. Calibration Conditions:

Air Temperature: 23.4 °C Air Pressure: 1005 hPa Relative Humidity: 68.5 %

#### Calibration Equipment: 3.

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV220061	HOKLAS

#### 4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of U		Setting of Unit-under-test (UUT)		Арр	Applied value		IEC 61672 Class 1
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	d <b>B</b>	Specification, dB
30-130	dBA	SPL	Fast	94	1000	93.8	±0.4

#### Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		93.8	Ref
30-130	dBA	SPL	Fast	104	1000	103.8	±0.3
				114		114.0	±0.3

# Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	0.1	1000	93.8	Ref
30-130		Slow	94	1000	93.8	±0.3	

Certificate No.: APJ22-071-CC001

Page 2 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946

Homepage: http://www.aa-lab.com E-mail: inquiry@aa-lab.com



Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. Wo	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	93.9	±2.0
					63	94.0	±1.5
					125	93.9	±1.5
	dB	dB SPL	Fast	94	250	93.8	±1.4
30-130					500	93.8	±1.4
					1000	93.8	Ref
			2000	93.4	±1.6		
					4000	93.0	±1.6
				8000	92.2	+2.1; -3.1	

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
			Fast	94	31.5	54.6	-39.4 ±2.0
					63	67.7	-26.2 ±1.5
		A SPL			125	77.8	-16.1 ±1.5
					250	85.2	-8.6±1.4
30-130	dBA				500	90.6	-3.2 ±1.4
					1000	93.8	Ref
			2000	94.6	+1.2 ±1.6		
				4000	94.0	+1.0 ±1.6	
					8000	91.2	-1.1 +2.1; -3.1

# C-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	90.9	-3.0 ±2.0
		63	63	93.1	-0.8 ±1.5		
					125	93.7	-0.2 ±1.5
		C SPL	Fast	94	250	93.8	$-0.0 \pm 1.4$
30-130	dBC				500	93.8	$-0.0 \pm 1.4$
					1000 93.8	Ref	
					2000	93.3	-0.2 ±1.6
					4000	92.2	-0.8 ±1.6
					8000	89.3	-3.0 +2.1; -3.1

Certificate No.: APJ22-071-CC001



Page 3 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946
Homepage: http://www.aa-lab.com E-mail:inquiry@aa-lab.com



# 5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.10
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

#### Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)\*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ22-071-CC001



Page 4 of 4

Page 1 of 2

Certificate No. D224269E



# CALIBRATION CERTIFICATE

Product : SOUND CALIBRATOR

Type : NC-75 Serial number : 34524163

Manufacturer : RION CO., LTD.

Calibration quantities : Sound pressure level (with reference standard microphone)

Calibration method : Measured by specified secondary standard microphone according to JCSS calibration procedure specified by RION.

Ambient conditions : Temperature 23.4 °C, Relative humidity 48 %,

Static pressure 100.9 kPa

Calibration date : 09/05/2022 (DD/MM/YYYY)

Calibration location : 3-20-41 Higashimotomachi, Kokubunji, Tokyo 185-8533, Japan

RION CO., LTD. Calibration Room

We hereby certify that the results of this calibration were as follows.

Issue date: 12/05/2022 (DD/MM/YYYY)

Junichi Kawamura

Manager

Quality Assurance Section, Quality Assurance Department, Environmental Instrument Division,

RION CO., LTD.

3-20-41 Higashimotomachi, Kokubunji,

Tokyo 185-8533, Japan

This certificate is based on article 144 of the Measurement Law and indicates the result of calibration in accordance with measurement standards traceable to Primary Measurement Standards (National Standards) which realizes the physical units of measurement according to the International System of Units (SI).

The accreditation symbol is attestation of which the result of calibration is traceable to Primary Measurement Standards (National Standards).

The certificate shall not be reproduced except in full, without the written approval of the issuing laboratory.

The calibration laboratory who issued this calibration certificate conforms to ISO/IEC 17025:2017.

This calibration certificate was issued by the calibration laboratory accredited by IAJapan who is a signatory to the Mutual Recognition Arrangement (MRA) of International Laboratory Accreditation Cooperation (ILAC) and Asia Pacific Accreditation Cooperation (APAC). This (These) calibration result(s) may be accepted internationally through ILAC/APAC MRA



Page 2 of 2

Certificate No. D224269E

# CALIBRATION RESULT

1. Sound pressure level (with reference standard microphone)

Measured	Expanded
value	uncertainty *1
93.98 dB	0.09 dB

Specified secondary standard microphone:

Type : 4160 Serial number : 2973341

Reference Sound pressure :  $2 \times 10^{-5}$  Pa

\*1 Defines an interval estimated to have a level of confidence of approximately 95 %. Coverage factor k=2

Calibration result is the calibration value in ambient conditions during calibration.

# BE OUT OF JCSS CALIBRATION

1. Frequency

Measured value	Measurement uncertainty (k=2)
1000.0 Hz	3.9×10 <sup>-4</sup> Hz

Working measurement standard universal counter:

Type : 53132A Serial number : MY40005574

(JCSS Calibration Certificate No. 21081499079575510)

2. Total distortion

Measured	
value	
0.3 %	


Working measurement standard distortion meter:

Type : VA-2230A Serial number : 11076061

(A2LA Calibration Certificate No. 1501-03080)

· closing ·



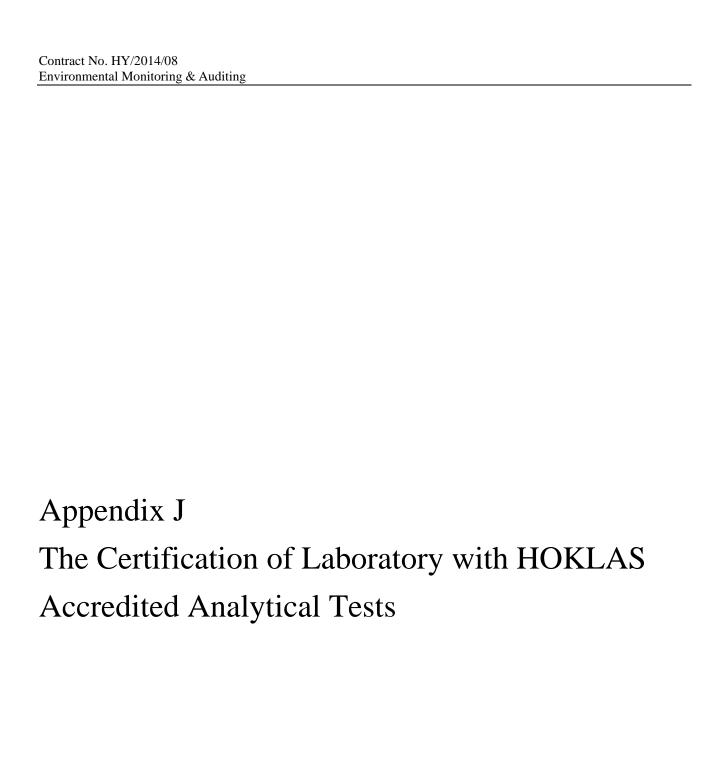



#### Hong Kong Accreditation Service 香港認可處

# **Certificate of Accreditation** 認可證書

This is to certify that 特此證明

#### ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Flat/Rm D, 12/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong

香港九龍長沙灣永康街37-39號福源廣場12樓D室

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

# **Environmental Testing**

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此项 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理關系 (見國際認可結婚、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 15 November 2021

簽發日期:二零二一年十一月十五日

Registration Number : HOKLAS 241

Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

This certificate is issued subject to the terms and conditions laid down by HKAS 本體書級照香港認可盡訂立的條款及條件發出

L002316



Hong Kong Accreditation Service 香港認可處

# **Certificate of Accreditation**

認可證書

This is to certify that 特此間明

# ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

# **Environmental Testing**

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to isboratory operation (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date : 28 February 2020

签發日期:二零二零年二月二十八日

註冊號碼:

Registration Number : HOKLAS 066


Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日


This certificate is issued subject to the terms and conditions laid down by HKAS. 本證書按照香港認可處訂立的條款及條件發出

L001934

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

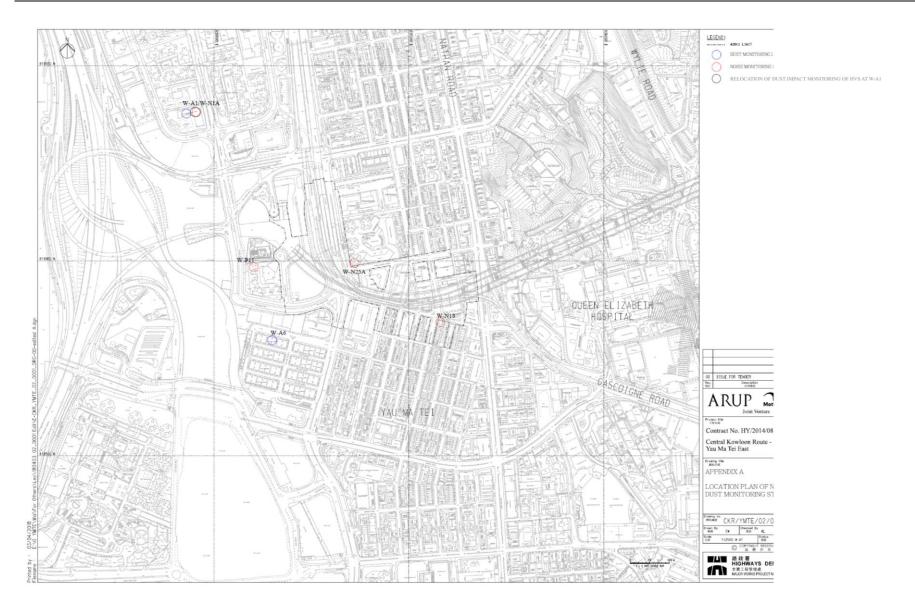

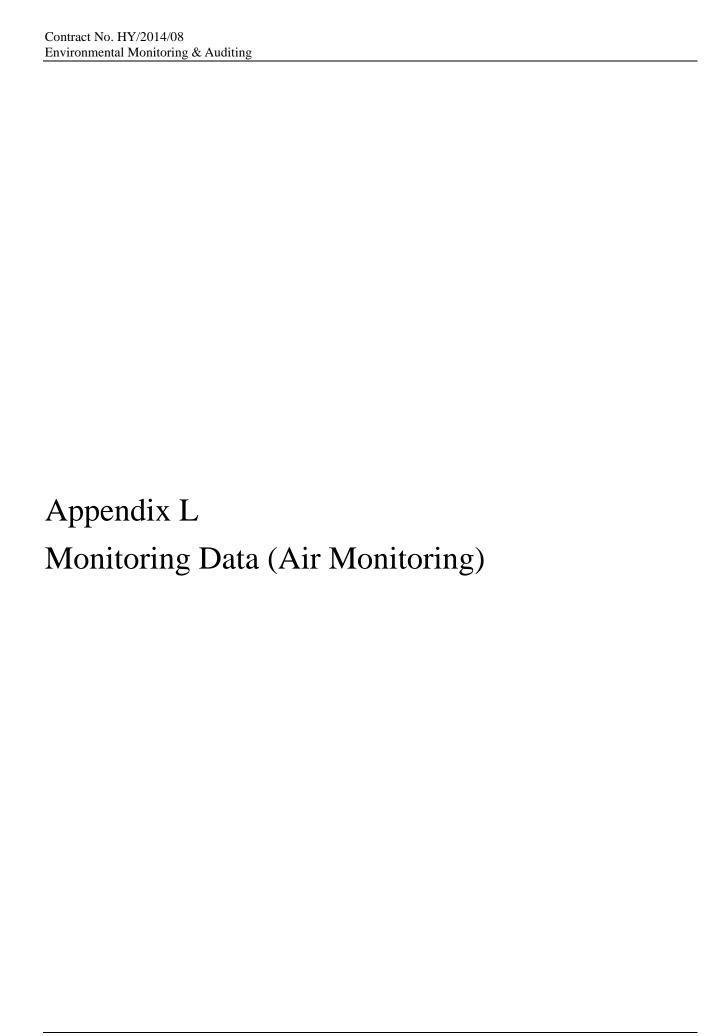

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 3, 9, 15, 21 and 27 March 2023

Parameter: TSP 1-hour Other Factors Nearby traffic

	1-hour TSP (μg/m³)							
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m³)	2 <sup>nd</sup> Hour (μg/m³)	3 <sup>rd</sup> Hour (μg/m³)			
03/03/2023	Sunny	9:45	60	65	58			
09/03/2023	Sunny	9:40	59	65	64			
15/03/2023	Sunny	12:22	54	66	67			
21/03/2023	Fine	13:01	59	67	66			
27/03/2023	Cloudy	11:10	52	61	68			
Min	imum: 52 μg/m <sup>2</sup>	3		Maximum: 68 μg/m <sup>3</sup>				

Location: Man Cheong Building (W-A6) Monitoring date: 3, 9, 15, 21 and 27 March 2023

Parameter: TSP 1-hour Other Factors Nearby traffic

	1-hour TSP (μg/m³)						
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m³)	2 <sup>nd</sup> Hour (μg/m³)	3 <sup>rd</sup> Hour (μg/m³)		
03/03/2023	Sunny	11:41	67	66	68		
09/03/2023	Sunny	11:45	70	68	66		
15/03/2023	Sunny	13:21	69	74	77		
21/03/2023	Fine	9:34	67	78	82		
27/03/2023	Cloudy	9:37	65	73	77		
	Minimum: 65	μg/m <sup>3</sup>		Maximum: 82 μg	$/\mathrm{m}^3$		

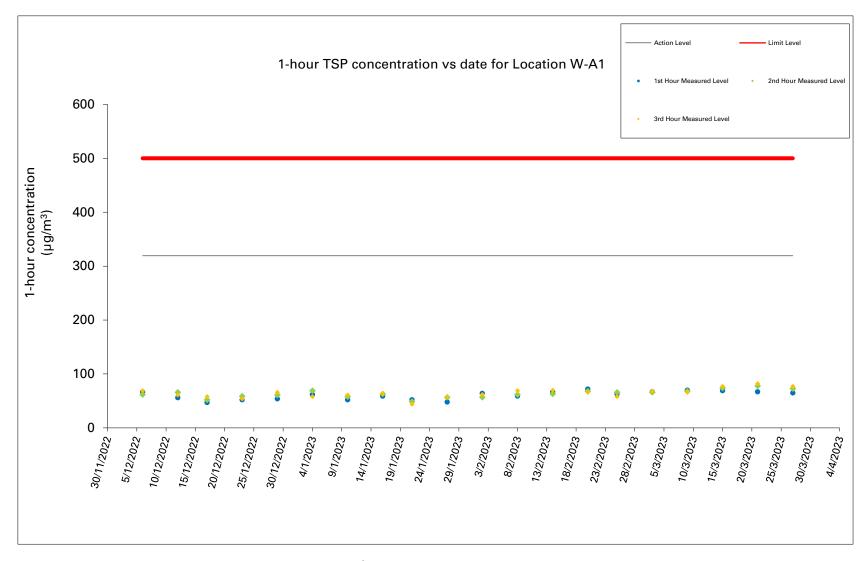


Figure 1: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A1

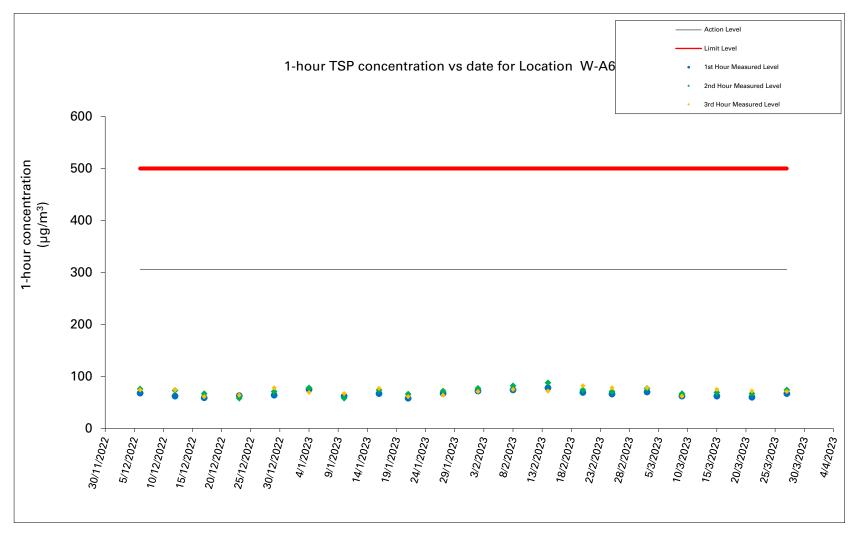


Figure 2: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A6

Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1) 3, 9, 15, 21 and 27 March 2023 Location:

Monitoring date:

TSP 24-hour Parameter: Other Factors Nearby traffic

Date of Calibration:	2-Mar-23	Slope =	5.9732
Calibration due date:	17-Mar-23	Intercept =	34.5951
Date of Calibration:	16-Mar-23	Slope =	9.5263
Calibration due date:	31-Mar-23	Intercept =	31.3189

Start Date	Weather Condition	Elapse Time			Chart Reading			Avg Air Temp	Avg Atmospheric Pressure	heric Flow Rate	Standard Air Volume	Filter Weight (g)		Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	( <b>m</b> <sup>3</sup> )	Initial	Final	(g)	(μg/m <sup>3</sup> )
3/3/2023	Sunny	7856.2	7880.2	1440.0	40	40	40.0	19.1	1024.7	1.05	1509	2.7732	2.9373	0.1641	109
9/3/2023	Sunny	7880.2	7904.2	1440.0	39	41	40.0	22.5	1017.7	0.96	1387	2.7505	2.9507	0.2002	144
15/3/2023	Sunny	7905.8	7929.8	1440.0	40	43	41.5	21.5	1017.9	1.23	1770	2.6804	2.7829	0.1025	58
21/3/2023	Fine	7929.8	7953.8	1440.0	43	43	43.0	24.2	1008.6	1.21	1745	2.6708	2.7276	0.0568	33
27/3/2023	Cloudy	7953.8	7977.8	1440.0	43	43	43.0	18.7	1016.9	1.29	1860	2.6708	2.7215	0.0507	27
					•					Maximum:	144	μg/m <sup>3</sup>	Minimum:	27	μg/m <sup>3</sup>

**Start Date** 

3/3/2023 9/3/2023 15/3/2023

21/3/2023

27/3/2023

Fine

Cloudy

7521.2

7545.2

7545.2

7569.2

1440.00

1440.00

40

36

47

38

43.5

37.0

24.2

18.7

Location: Man Cheong Building (W-A6) Monitoring date: 3, 9, 15, 21 and 27 March 2023

Parameter: TSP 24-hour Other Factors Nearby traffic

										on due date:	17-Mar-23		Intercept =	31.7825	
									Date of Calibration:		16-Mar-23		Slope =	8.6061	
											31-Mar-23		Intercept =	32.2082	
Weather Condition -	Elapse Time			Chart Reading			Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter Weight (g)		Particulate weight	Conc.	
	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$	
Sunny	7443.9	7467.9	1440.00	40	40	40.0	19.1	1024.7	0.93	1340	2.7883	2.9795	0.1912	143	
Sunny	7467.9	7491.9	1440.00	38	39	38.5	22.5	1017.7	0.72	1041	2.6628	2.7917	0.1289	124	
Sunny	7497.2	7521.2	1440.00	38	39	38.5	21.5	1017.9	0.73	1052	2.6541	2.7679	0.1138	108	

1008.6

1016.9

1.30

0.62

Maximum:

Date of Calibration:

1866

891

2-Mar-23

2.6749

2.6657

\_**143** μg/m<sup>3</sup>

2.7358

2.7289

Minimum:

Slope =

0.0609

0.0632

9.7505

33

71

33  $\mu g/m^3$ 

Acuity Sustainability Consulting Ltd.

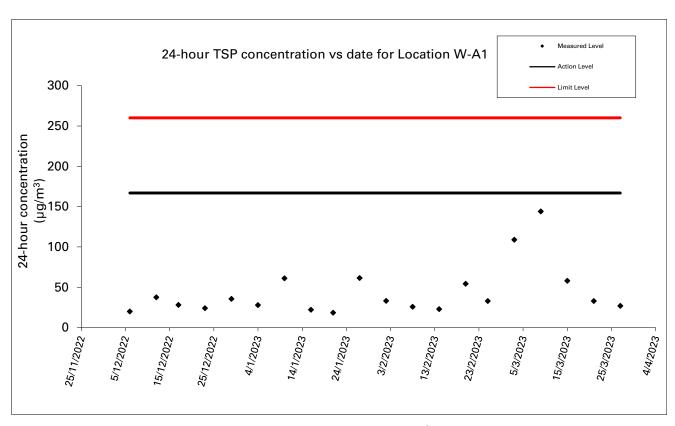


Figure 3: Graphical Illustration of Measured 24-hour TSP (µg/m³) Levels at W-A1




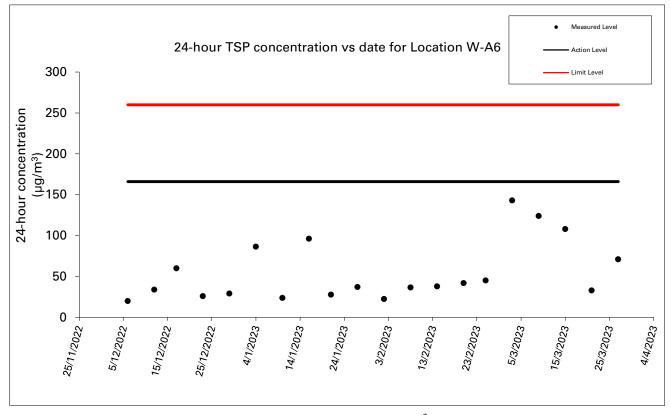



Figure 4: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at W-A6


# Wind direction data for 3, 4, 9, 10, 15, 16, 21, 22, 27 and 28 March 2023

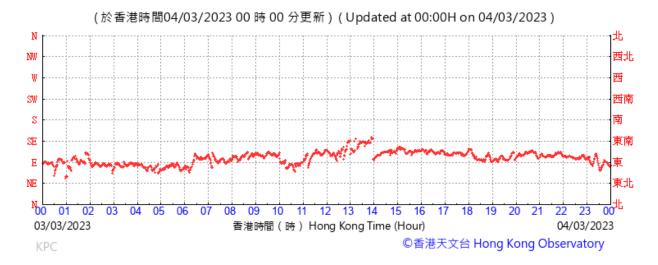


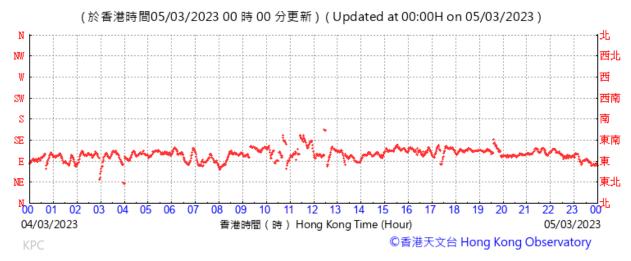


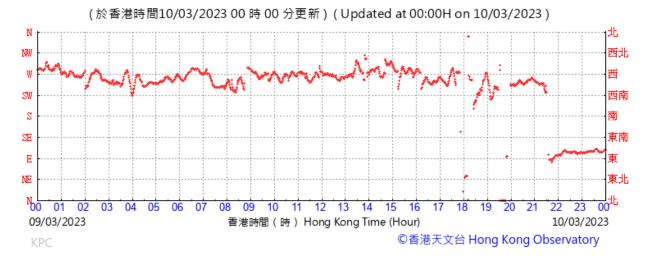


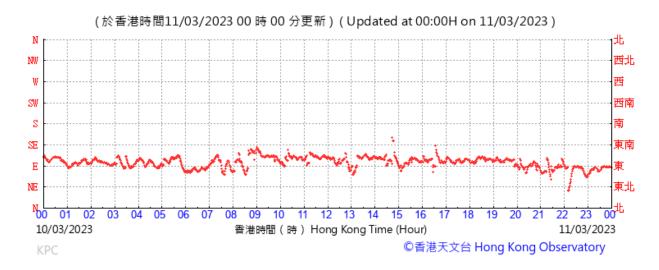


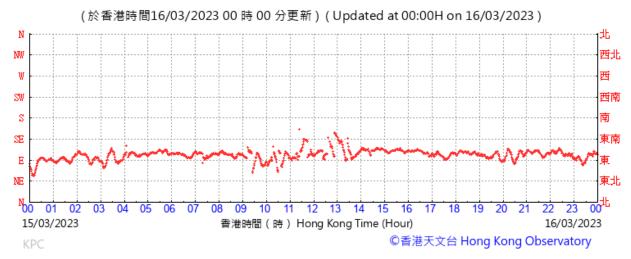


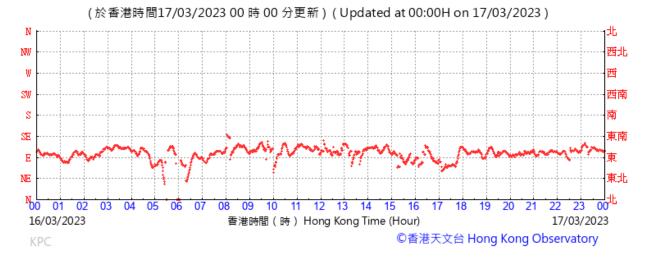

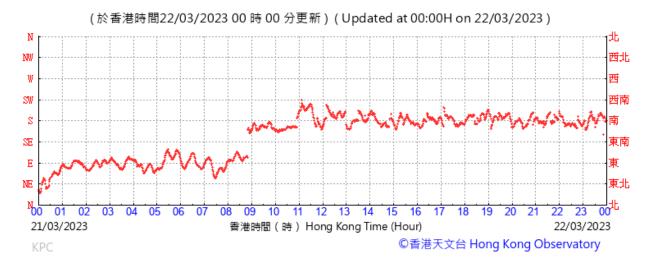


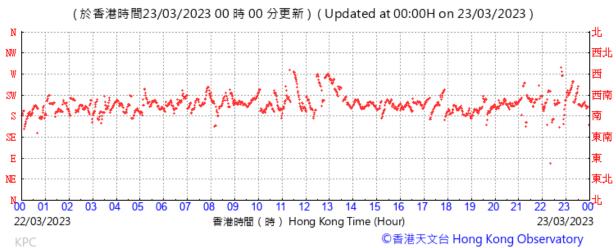

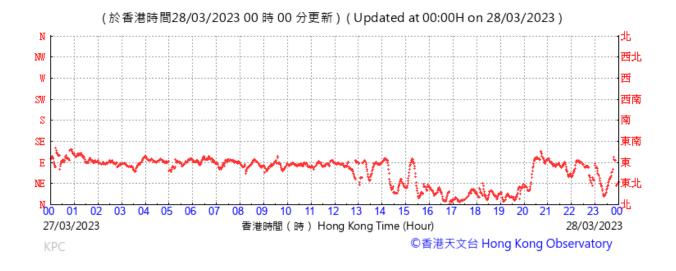


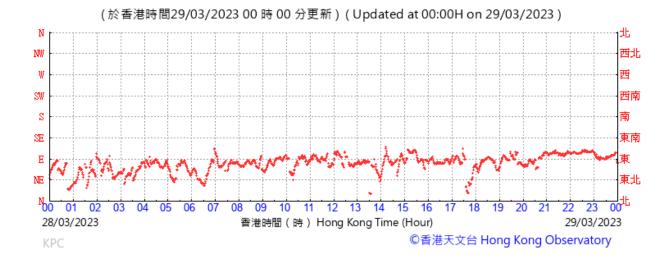

# Wind speed data for 3, 4, 9, 10, 15, 16, 21, 22, 27 and 28 March 2023

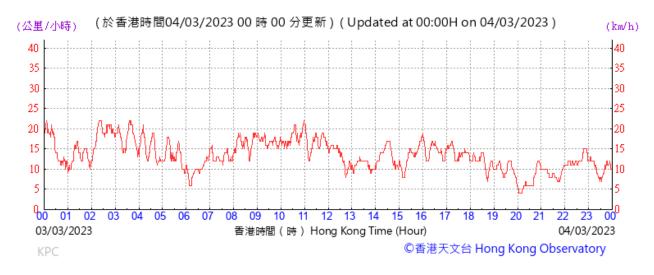





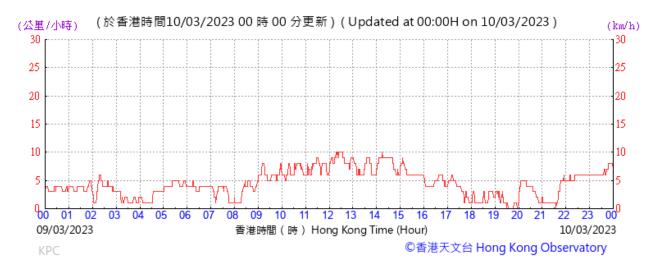





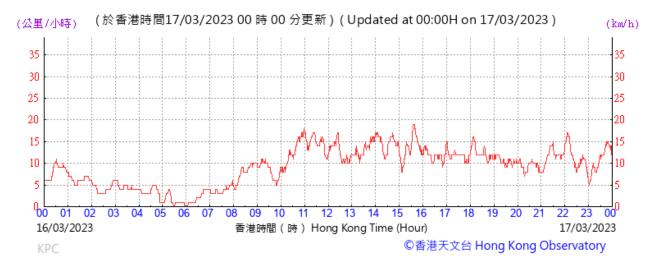

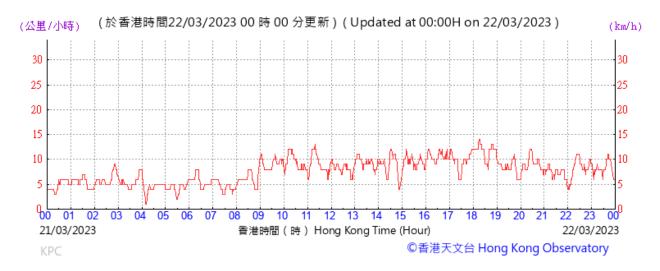







Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix M Monitoring Data (Noise) Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)

Monitoring date: 3, 9, 15, 21 and 27 March 2023

 $\begin{array}{ll} \text{Parameter:} & L_{\text{eq}},\,L_{10},\,L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$ 

### Noise Monitoring data:

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
03/03/2023	Sunny	9:47	-	10:17	64.3	66.8	60.3	4.7
09/03/2023	Sunny	9:40	-	10:10	59.1	65.1	59.7	1.4
15/03/2023	Sunny	12:25	-	12:55	60.9	63.0	56.6	2.8
21/03/2023	Fine	13:04	-	13:34	59.3	61.4	56.6	1.9
27/03/2023	Cloudy	11:05	-	11:35	59.7	61.1	56.3	4.5

Remark: 1. Examination was carried out at Yau Ma Tei Catholic Primary School from 2 March 2023 to 7 March 2023. The limit level of W-N1A on 3 March 2023 would be 65 dB(A).

Location: Hydan Place (W-N18)

Monitoring date: 3, 9, 15, 21 and 27 March 2023

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, \ L_{90} \\ Other \ Factors & Nearby \ traffic \end{array}$ 

# Noise Monitoring data:

Date	Weather	Start Time	-	End Time	$L_{eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
03/03/2023	Sunny	14:25	-	14:55	70.3	71.6	66.6	3.6
09/03/2023	Sunny	14:22	-	14:52	70.2	71.7	66.4	2.2
15/03/2023	Sunny	10:01	-	10:31	72.6	75.1	66.3	2.1
21/03/2023	Fine	9:50	-	10:20	69.2	70.9	66.7	3.1
27/03/2023	Cloudy	14:03	-	14:33	72.7	74.6	66.8	2.8

Location: Prosperous Garden Block 1 (W-N25A)

Monitoring date: 3, 9, 15, 21 and 27 March 2023

 $\begin{array}{ll} Parameter: & L_{eq,}\,L_{10,}\,\,L_{90} \\ Other\,\,Factors & Nearby\,\,traffic \end{array}$ 

# Noise Monitoring data:

Date	Weather	Start Time	-	End Time	L <sub>eq</sub>	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
03/03/2023	Sunny	13:40	-	14:10	70.7	72.1	69.0	3.1
09/03/2023	Sunny	13:38	-	14:08	70.5	72.2	68.5	2.1
15/03/2023	Sunny	9:17	-	9:47	71.0	74.4	66.7	3.3
21/03/2023	Fine	10:32	-	11:02	69.1	70.6	67.3	2.2
27/03/2023	Cloudy	13:08	-	13:38	71.0	72.9	66.5	3.5

Location: The Coronation Tower 1 (W-P11)

Monitoring date: 3, 9, 15, 21 and 27 March 2023

 $\begin{array}{ll} \text{Parameter}: & L_{\text{eq}}, L_{10}, L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$ 

# Noise Monitoring data:

Date	Weather	Start Time	-	End Time	$L_{eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
03/03/2023	Sunny	10:44	-	11:14	69.4	71.2	66.5	4.4
09/03/2023	Sunny	10:40	-	11:10	68.9	70.4	65.5	2.2
15/03/2023	Sunny	11:04	-	11:34	67.6	69.1	65.3	2.8
21/03/2023	Fine	11:41	-	12:11	66.5	71.0	65.3	2.5
27/03/2023	Cloudy	10:09	_	10:39	66.7	68.1	64.6	4.8

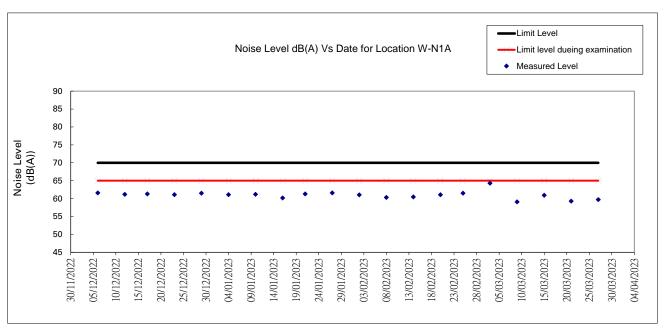


Figure 1: Graphical Illustration of Measured Noise Levels at W-N1A

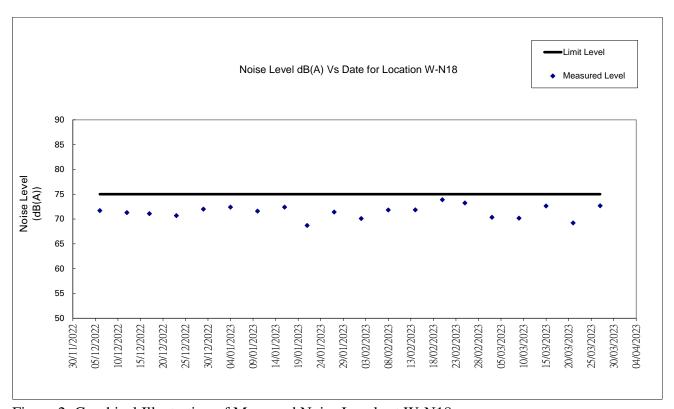


Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

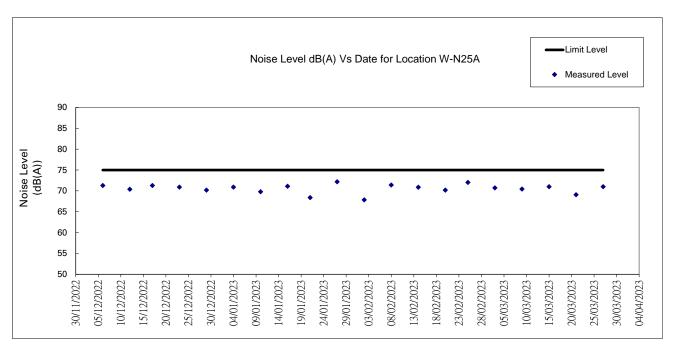


Figure 3: Graphical Illustration of Measured Noise Levels at W-N25A

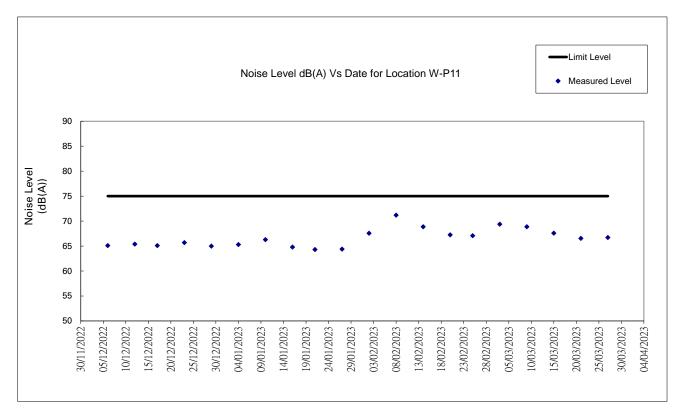


Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix N
Waste Flow Table

# **Monthly Summary Waste Flow Table**

Name of Department: Highways Department

Contract No. / Works Order No.: <u>HY/2014/08</u>

**Monthly Summary Waste Flow Table for March 2023** 

[to be submitted not later than the 15<sup>th</sup> day of each month following reporting month] (All quantities shall be rounded off to 1 decimal place.)

	·					
		Actı	ıal Quantities of <u>Ine</u>	ert Construction Wa	ste Generated Mon	thly
	(a)=(b)+(c)+(d)+(e)+(f)+(g)+(h)+(i)+(j)+(k)	(b)	(c)	(d)	(e)	(f)
Month	Total Quantity Generated	Hard Rock and	Reused in the	Reused in other	Disposed of as	(f) Imported Fill
	Total Qualitity delicrated	Large Broken	Contract	Projects	Public Fill	imported rin
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)
Jan-23	7222.30	304.00	0.00	0.00	6860.90	0.00
Feb-23	9593.30	3125.30	0.00	3197.40	3189.10	0.00
Mar-23	18282.70	878.90	0.00	4345.60	12936.50	0.00
Apr-23						
May-23						
Jun-23						
Sub-total	35098.20	4308.20	0.00	7543.000	22986.50	0.00
Jul-23						
Aug-23						
Sep-23						
Oct-23						
Nov-23						
Dec-23						
Total	35098.20	4308.20	0.00	7543.000	22986.50	0.00
2018	51057.90	0.00	0.00	0.00	47715.60	2877.40
2019	112830.10	541.00	1523.80	13525.00	93132.90	3155.60
2020	193021.92	58778.00	1205.60	19108.60	112556.80	0.00
2021	104679.02	6461.30	1393.70	1144.70	92950.20	1542.90
2022	114787.22	3600.50	1804.50	18471.20	90202.70	0.00
Accumulated Total	611474.46	73689.00	5927.60	59792.50	459544.70	7575.90

	Actual Quantities of Non-inert Construction Waste Generated Monthly								nly
Month		g) tals	(h) Paper/ cardboard packaging		(i Plas		(j) Chemical Waste		(k) Others, e.g. General Refuse disposed at Landfill
	(in '0	00kg)	(in '00	00kg)	(in '00	00kg)	(in '0	00kg)	(in 'tonnes)
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated
Jan-23	0.00	0.00	0.00	0.20	0.00	0.00	0.00	0.00	57.20
Feb-23	0.00	0.00	0.00	0.20	0.00	0.00	0.00	0.00	81.30
Mar-23	0.00	0.00	0.00	0.20	0.00	0.00	0.00	0.00	121.40
Apr-23									
May-23									
Jun-23									
Sub-total	0.00	0.00	0.00	0.60	0.00	0.00	0.00	0.00	259.90
Jul-23									
Aug-23									
Sep-23									
Oct-23									
Nov-23									
Dec-23									
Total	0.00	0.00	0.00	0.60	0.00	0.00	0.00	0.00	259.90
2018	28.40	0.00	0.00	0.00	0.00	0.00	2.00	0.00	434.50
2019	0.00	9.10	3.40	6.80	0.00	0.00	5.20	0.00	927.30
2020	69.20	0.00	3.30	0.00	0.02	0.00	25.30	0.00	1275.10
2021	30.20	0.00	4.80	0.00	0.02	0.00	25.50	0.00	1125.70
2022	108.60	0.00	3.30	0.40	0.02	0.00	1.20	0.00	594.80
Accumulated Total	236.40	9.10	14.80	7.80	0.06	0.00	59.20	0.00	4617.30



Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

Statistical Summary of Exceedances

	Air Quality							
Reporting Period	Action Level	Limit Level						
1 – 31 March 2023	0	0						
	Noise							
Reporting Period	Action Level	Limit Level						
1 – 31 March 2023	8	0						

Statistical Summary of Environmental Complaints

Donarting Daried	Environmental Complaint Statistics						
Reporting Period	Frequency	Cumulative	Complaint Nature				
1 – 31 March 2023	7	75	Noise and air quality				

Statistical Summary of Environmental Non-compliance


Donouting Donied	En	vironmental Non-compliance	Statistics
Reporting Period	Frequency	Cumulative	Details
1 – 31 March 2023	1	2	Noise

Statistical Summary of Environmental Summons


Departing Deried	Environmental Summons Statistics					
Reporting Period	Frequency	Cumulative	Details			
1 – 31 March 2023	0	1	N/A			

Statistical Summary of Environmental Prosecution

D 4: D : 1		Environmental Prosecution Sta	atistics
Reporting Period	Frequency	Cumulative	Details
1 – 31 March 2023	0	0	N/A

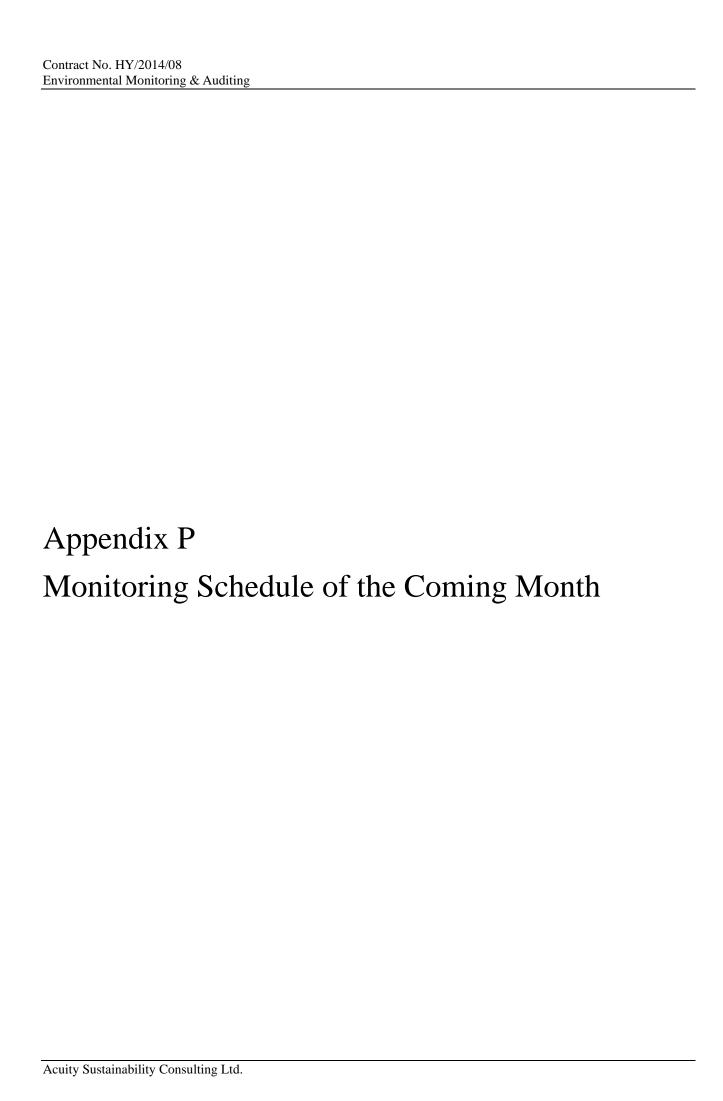


		Impa	nct Monitoring Schedule for	YMTE		
		•	Apr-23			
Sun	Mon	Tue	Wed	Thu	Fri	Sat
						Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A
2		4	S	6 Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	7	8
9	10	Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A	12	13	14	15
16	Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A	18	19	20	21	Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A
23	24	25	26	27	Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A	29
30						

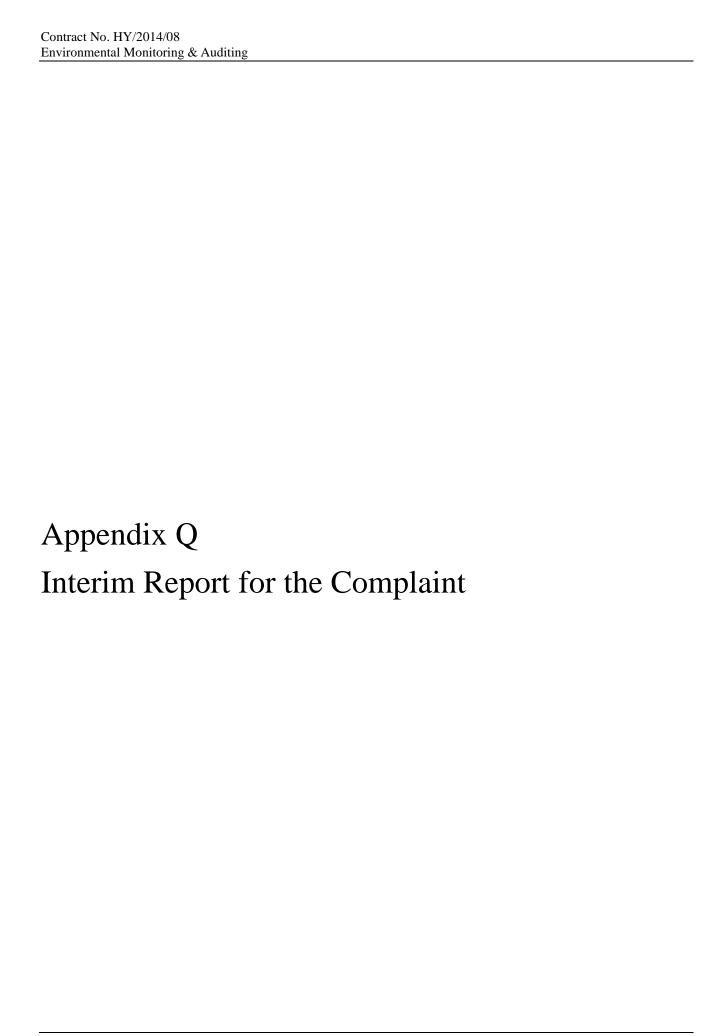

Project Central Kowloon Route, Yau Ma Tei East Section Complaint Code ECO67-CKRYMTE02032024 003 and YMTE ICC 164r1 The complainant complained that dripping water was found from the construction site at Gascoigne Road Flyover, near Shanghai Street to the pedestrian zone on 24 Feb 2023 and 6 Mar 2023.  Parameter Investigation finding The complainant made the complaint on 24 Feb 2023 and was concerned about the dripping water from P5, and follow-up complaint was received on 6 Mar 2023.  According to site record, welding works were conducted at P5 during daytime on 24 Feb 2023. The dripping water was suspected from water hose which was not closed tightly. Since the dripping water was directly discharged from water hose which was not closed tightly. Since the dripping water was directly discharged from water hose which was not closed tightly. Since the dripping water was directly discharged from water hose which was not closed tightly. Since the dripping water was directly discharged from water hose the dripping water was no non-compliance of the Project regarding water according to site record. The contractor investigated the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water inspect from construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken.  The loosened water hose was closed tightly;  Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dr	<b>D</b>	G . 177 1 1	D . X7 M TD .	E . G .:	
The complainant complained that dripping water was found from the construction site at Gascoigne Road Flyover, near Shanghai Street to the pedestrian zone on 24 Feb 2023 and 6 Mar 2023.  Parameter Water Quality Investigation finding The complainant made the complaint on 24 Feb 2023 and was concerned about the dripping water was found follow-up complaint was received on 6 Mar 2023.  According to site record, welding works were conducted at P5 during daytime on 24 Feb 2023. The dripping water was suspected from water hose which was not closed tightly. Since the dripping water was suspected from water hose, the dripping water was not classified as wastewater as confirmed by the contractor.  On 6 Mar 2023, fencing installation works was conducted at P5 during daytime, according to site record. The contractor investigated the concerned area after the complaint had been made, but no dripping water was found. Bund was set up along the bridge after investigation to prevent surface runoff outside the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water inpact from construction site.  Actions taken / to be taken  Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  • The loosened water hose was closed tightly;  • Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  • Add impervious sheeting at the base of the bridge to block water dripping from the bridge:  • Provide bund along the bridge to prevent surface runoff outside the construction site; and  • Divert dripping water to the site for treatment.  1. Works location of the concerned area  2. Bund along the bridge	-				
site at Gascoigne Road Flyover, near Shanghai Street to the pedestrian zone on 24 Feb 2023 and 6 Mar 2023.  Parameter  Water Quality  The complainant made the complaint on 24 Feb 2023 and was concerned about the dripping water from P5, and follow-up complaint was received on 6 Mar 2023.  According to site record, welding works were conducted at P5 during daytime on 24 Feb 2023. The dripping water was suspected from water hose which was not closed tightly. Since the dripping water was directly discharged from water hose, the dripping water was not closed tightly. Since the dripping water was directly discharged from water hose, the dripping water was not closed tightly.  On 6 Mar 2023, fencing installation works was conducted at P5 during daytime according to site record. The contractor investigated the concerned area after the complaint had been made, but no dripping water was found. Bund was set up along the bridge after investigation to prevent surface runoff outside the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water impact from construction site.  Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  • The loosened water hose was closed tightly;  • Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  • Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  • Provide bund along the bridge to prevent surface runoff outside the construction site; and  • Divert dripping water to the site for treatment.  Remarks  (Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hon	•				
Parameter	Complaint description				
Parameter   Water Quality   The complainant made the complaint on 24 Feb 2023 and was concerned about the dripping water from P5, and follow-up complaint was received on 6 Mar 2023.				ear Shanghai Street to the pedestrian zone on 24	
The complainant made the complaint on 24 Feb 2023 and was concerned about the dripping water from P5, and follow-up complaint was received on 6 Mar 2023.  According to site record, welding works were conducted at P5 during daytime on 24 Feb 2023. The dripping water was suspected from water hose, which was not closed tightly. Since the dripping water was directly discharged from water hose, the dripping water was not classified as wastewater as confirmed by the contractor.  On 6 Mar 2023, fencing installation works was conducted at P5 during daytime, according to site record. The contractor investigated the concerned area after the complaint had been made, but no dripping water was found. Bund was set up along the bridge after investigation to prevent surface runoff outside the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water impact from construction site.  Actions taken/to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  The loosened water hose was closed tightly;  Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  Provide bund along the bridge to prevent surface runoff outside the construction site; and  Divert dripping water to the site for treatment.  Kako Ho  Reviewed by FTI  (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Mandy To  Mandy To  Mandy To  Mandy To	<b>D</b>		1ar 2023.		
dripping water from P5, and follow-up complaint was received on 6 Mar 2023.  According to site record, welding works were conducted at P5 during daytime on 24 Feb 2023. The dripping water was suspected from water hose, which was not closed tightly. Since the dripping water was directly discharged from water hose, the dripping water was not classified as wastewater as confirmed by the contractor.  On 6 Mar 2023, fencing installation works was conducted at P5 during daytime according to site record. The contractor investigated the concerned area after the complaint had been made, but no dripping water was found. Bund was set up along the bridge after investigation to prevent surface runoff outside the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water impact from construction site.  Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  • The loosened water hose was closed tightly;  • Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  • Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  • Provide bund along the bridge to prevent surface runoff outside the construction site; and  • Divert dripping water to the site for treatment.  Remarks  (Shown in next page)  Reviewed by ETL (Acuity Sustainability Consulting Limited)		` '	1 1 1 1 1	04 F.1 2022 1 1 1 1 4 4	
2023. The dripping water was directly discharged from water hose, the dripping water was not classified as wastewater as confirmed by the contractor.  On 6 Mar 2023, fencing installation works was conducted at P5 during daytime according to site record. The contractor investigated the concerned area after the complaint had been made, but no dripping water was found. Bund was set up along the bridge after investigation to prevent surface runoff outside the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water impact from construction site.  Actions taken / to be taken  Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  • The loosened water hose was closed tightly;  • Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  • Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  • Provide bund along the bridge to prevent surface runoff outside the construction site; and  • Divert dripping water to the site for treatment.  Remarks (Shown in next page)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Mandy To Mandy T	Investigation finding	_	-		
according to site record. The contractor investigated the concerned area after the complaint had been made, but no dripping water was found. Bund was set up along the bridge after investigation to prevent surface runoff outside the construction site.  Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual, it is concluded that there was no non-compliance of the Project regarding water impact from construction site.  Actions taken / to be taken  Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  • The loosened water hose was closed tightly;  • Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  • Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  • Provide bund along the bridge to prevent surface runoff outside the construction site; and  • Divert dripping water to the site for treatment.  Remarks (Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Werified by IEC (ERM-Hong Kong, Limited)  Mandy To Mandy To Mandy To		2023. The dripping Since the dripping	g water was suspect g water was directle	ted from water hose which was not closed tightly. y discharged from water hose, the dripping water	
manual, it is concluded that there was no non-compliance of the Project regarding water impact from construction site.  Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  • The loosened water hose was closed tightly;  • Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  • Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  • Provide bund along the bridge to prevent surface runoff outside the construction site; and  • Divert dripping water to the site for treatment.  Remarks (Shown in next page)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To Mand		according to site complaint had bee	record. The cont on made, but no dri	ractor investigated the concerned area after the pping water was found. Bund was set up along the	
Actions taken / to be taken  The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize water pollution to the public.  In view of public concerns, the following preventative measures were taken / to be taken:  The loosened water hose was closed tightly;  Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  Provide bund along the bridge to prevent surface runoff outside the construction site; and  Divert dripping water to the site for treatment.  Remarks (Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To Mandy To Mandy To Limited		manual, it is concl	uded that there was		
taken:  The loosened water hose was closed tightly;  Provide checking and maintenance on water hose regularly to prevent damage of loosening.  If any dripping is observed, the following additional remedial measures will be taken:  Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  Provide bund along the bridge to prevent surface runoff outside the construction site; and  Divert dripping water to the site for treatment.  Remarks  Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To Mand	Actions taken / to be taken	The Contractor ha	d followed EM&A		
Provide checking and maintenance on water hose regularly to prevent damage or loosening.  If any dripping is observed, the following additional remedial measures will be taken:  Add impervious sheeting at the base of the bridge to block water dripping from the bridge;  Provide bund along the bridge to prevent surface runoff outside the construction site; and  Divert dripping water to the site for treatment.  Remarks (Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Ma		taken:			
<ul> <li>Add impervious sheeting at the base of the bridge to block water dripping from the bridge;</li> <li>Provide bund along the bridge to prevent surface runoff outside the construction site; and</li> <li>Divert dripping water to the site for treatment.</li> </ul> Remarks <ul> <li>(Shown in next page)</li> </ul> Prepared by ET <ul> <li>(Acuity Sustainability Consulting Limited)</li> </ul> Reviewed by ETL <ul> <li>(Acuity Sustainability Consulting Limited)</li> </ul> Kevin Li <ul> <li>Werified by IEC</li> <li>(ERM-Hong Kong, Limited)</li> </ul> Mandy To <ul> <li>Mandy To</li> </ul> Mandy To	Provide checking and maintenance on water hose loosening.		<u> </u>		
Provide bund along the bridge to prevent surface runoff outside the construction site; and     Divert dripping water to the site for treatment.  Remarks (Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Mandy		Add impervious sheeting at the base of the bridge to block water dripping from			
Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Pivert dripping water to the site for treatment.  1. Works location of the concerned area 2. Bund along the bridge to prevent surface runoff outside the construction site  Kako Ho  Kevin Li  Kevin Li  Mandy To  Mandy To  Mandy To  Mandy To	Provide bund along the bridge to prevent surface runoff outside		e to prevent surface runoff outside the construction		
Remarks (Shown in next page)  1. Works location of the concerned area 2. Bund along the bridge to prevent surface runoff outside the construction site  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Mandy To		· ·	site; and		
(Shown in next page)  Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To					
Prepared by ET (Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Mandy To					
(Acuity Sustainability Consulting Limited)  Reviewed by ETL (Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Mandy To	(Shown in next page)	2. Bund alon	g the bridge to prev	vent surface runoff outside the construction site	
(Acuity Sustainability Consulting Limited)  Verified by IEC (ERM-Hong Kong, Limited)  Mandy To  Mandy To	(Acuity Sustainability	Kako Ho	Ho		
Limited)	(Acuity Sustainability	Kevin Li	K		
Date 13 March 2023	(ERM-Hong Kong,	Mandy To	Mandy 2.		
	Date	13 March	2023		

關令銀行才 Bangkok Bank i Ek Nar Ruby C M 平安大傳 彌敦道 模站的 全學社画 Public Square Street Rest Carden Œ 創造機 Cheong Yuen Lau 恩 編製器4854號 485a Nathan Road Le Chateau 第腳 甘屬田 報商大廈 Arts Mansion 層配商業大廈 K.k. Centre 油脂社停車場大廠 Yaumatei Carpark Building 油脂地大加脂 資於 1864 年的中華著台灣區 永星大廈 The concerned area Œ 街中街 部目大庫 Fu Cheong Building 政務資訊整理調品 Silka Ssaview Hotel - Hong Kong 多品 吕茂大章 Cheong Mow Building 興記獎仔飯 影響酒 甘霖大康 Kum Lam Building 太極軒279 Chi Residences 279 • Œ 上海街 • Yau Ma Tei Jockey Club 他田春 Kim Tin Building 東部大廠 Wing Sheung Building 照體語 和阿歐 油麻地街市 Ma Tei Market B斯大衛 Chee Sun Building 西九龍走廊 金沙斯园 Garden 0 中華基督教會 灣仔堂基道小學 Churchof Christ in Chin (CCC) Wanchal 0 表界大概 Dickson Building 受世回: 百老匯電影中心 驗發花圓 0 歐東斯 蒙發花園5座 Prosperous Garden Block 5 W 廣東道 Remark 1: Works location of the concerned area ß 開油 東北回春春方龍泉梅安 Tung Koon District Society Fong Shu... 医協長者安居資源中心 Housing Society Elderly Prosperous Garden Block 4 嚴緊花腦4座 思坊街 新春機械 Vau Ma Tei Police Station 60 甘爾街 治動基础力站 Yaumatei Electric Substation D 製器花園停車場 Proces Prosperous Garden Car Park Prosperous Garden Block 1 0 報發花園1座 Prosperous Garden Block 2 駿賢花園2座 製器花園3座 Prosperous Garden Block 3 治動性天主教小學 Yaumati Catholic Primary School 滑平街 Œ 渡船街 渡船街 滑平街 渡船街 港船新 街 Ferry St 渡船街天橋 西九龍走廊 阿爾亞 Hau Cheung St 4100

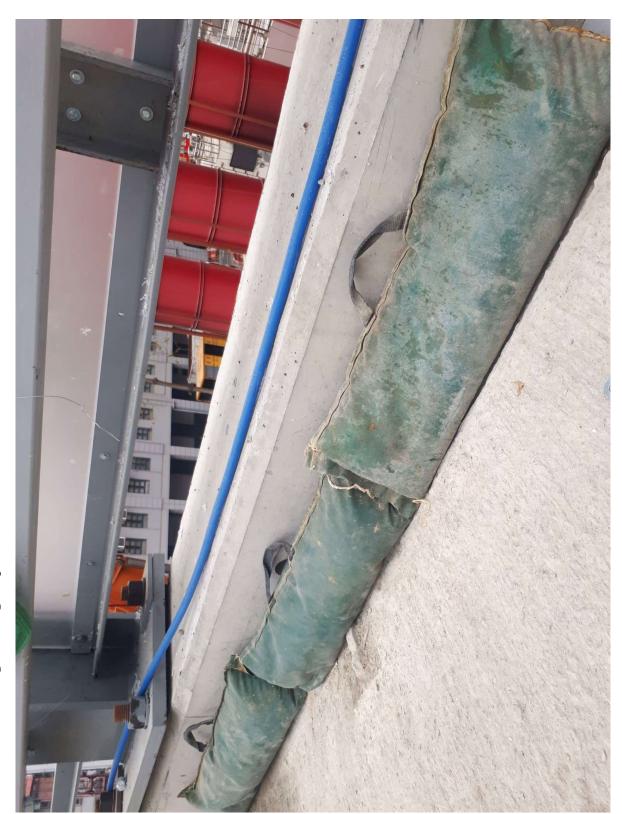

Remark 2: Bund along the bridge to prevent surface runoff outside the construction site

I	T = :		
Project		Route, Yau Ma Tei	East Section
Complaint Code	EC070-CKRYMT		the construction resign from the president site on 9
Complaint description	Mar 2023 at arou		the construction noise from the project site on 8
Parameter	Construction Nois		
Investigation finding			vas construction noise from site area P4 <sup>1</sup> on 8 Mar
investigation intuing	2023 at around 20		vas construction noise from site area 1 4 on 6 iviai
	2023 at around 20	00 to 2200.	
			ne complainant, a lorry was operating during night- ecording time and date.
	(CNP) (Permit No 2023 with covered Canton Road, Yau	e: GW-RE0103-23) I of the construction I Ma Tei, Kowloon.	actor applied for valid Construction Noise Permits which was granted from EPD, effective on 7 Feb in site at Kansu Street between Shanghai Street and according to the conditions setting out in the CNP
	construction vehic crane was operatin RE0103-23. Adva	ele was being operang from 0100 to 06 nce notification <sup>2</sup> has	on, no information showed that the concerned ted from 1900 to 0100 on 8 Mar 2023. Lorry with 00 on 9 Mar 2023, which is covered by CNP GW-as been made to EPD via online system before 48 at No PCWs were carried out.
	time claimed by the compliance of the	ne complainant, thu Project regarding n	a showing the operation was performed during the is there was not enough information showing non-oise impact from construction site.
Actions taken / to be taken	There was not en noise impact from		showing non-compliance of the Project regarding
	taken:		lowing preventative measures were taken / to be ion work properly to avoid PMEs operation during
	restricted 1		ion work property to avoid rivies operation during
	• In case of operated a additional possible; a	f PMEs required to according to the co noise mitigation and	o operate during restricted hours, PMEs shall be onditions of granted CNP(s) and make use of any measures to further mitigate the noise impact if staff about noise mitigation measures according to
	the conditions of granted CNP(s).		
D	1 337 1 1	-4:	
Remarks (Shown in next page)		ation of the concernotification	ned area
	2. Advance i	ionneanon	
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho	
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K	
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy2.	
Date	16 March	2023	

概令銀行才 Bangkok Bank B EK Nar Ruby Co 車百 OK. Œ 平安大理〇 彌敦道 • 無法 本意在 Public Square Streer Rest Garden 03 Cheong Yuen Lau 图 創版機 編象路4854號 485a Nathan Road Le Chateau 銀腳 拉爾班 報資大廈 Arts Mansion 層阻熔器大概 K.k Centre ● 新華地天后聯 ● 1864年的時報者台灣軍 Carpark Building 永星大廈 Œ **Concerned Area** 革命中心 rdan Place 斯司大阪 Fu Cheong Building 取效移物等額別の Silka Seaview Flotel - Hong Kong Jade Market, Jordan 玉布製商品攤聚戲集的廣唱 吕茂大庶 Cheang Mow Building 架器利油需地社區中心 Henry G. Leong Yau Ma Tel Community Centre 中華工 甘雲大嶽 Kum Lam Building 太極軒279 Chi Residences 279 製物街 • 上海街 (3 Yau Ma Tei Jockey Club 永智大學 Wing Sheung Building 配圖語 B B M A M Chee Sun Building 思坊街 E 油麻地街市 Yau Ma Tel Market 新春年的衛龍田教物學 Nau Ma Teil Onthodomic Clinic 金路衛園 Jolly Garden 西九龍走 0 中華基留教會 選仔堂基施小學 Church of Christ in Chri 機界大型 Dickson Building 百老匯電影中心□ 回車機 嚴發花圓 0 watells See Prosperous Garden Block 5 重素劑 0 廣東道 ß 東班回春東方祖祭神校 Tung Koon District Society Fong Shu... 阿達 養験花間4序 Prosperous Garden Block 4 医協長者安居資源中心 Housing Society Elderly 恩坊街 施制基礎期 Vau Ma Tei Police Station 甘爾街 坐動器細力部 Yaumatei Electric Substation 裝毀花圈停車場 9 Prosperous Garden Car Park Prosperous Garden Block 1 駿雪花園1座 職器花園2座 Prosperous Garden Block 2 0 製製花園3座 Prosperous Garden Block 3 治動地天主教小學 Yaumati Catholic Primary School 潭平街 Œ 渡船街 潛平街 渡船街 漫平街 渡船街 海船艇 街 Ferry St 文昌街公園 龍物公園 Street Park Per Garden 渡船街天橋 西九龍走廊 製器配 Hau Cheung St

Remark 1: Works location of the concerned area

# Remark 2: Advanced Notification

2023/3/14 下午3:22

Mail - Lee Wan Chung, Leo - Outlook

[Acknowledgement] GW-RE0103-23 Yau Tsim Mong

Online Submission for Advance Notification of CNPs <admin@nco-emergencywork.hk>

Sat 3/4/2023 9:19 AM

To: Lee Wan Chung, Leo <leo.lee@buildking.hk>

Allow sender | Block sender CAUTION: This email originated from outside of the company, DO NOT click links or open attachments unless you recognise the sender

This email acknowledges your advance notification submitted at 04/03/2023 on 09:18. Information appended below:

CNP No. :	GW-RE0103-23
Date and time of receiving notification : 04/03/2023 09:18:45	04/03/2023 09:18:45
Notification Ref:	GW-RE0103-23-011
CNP holder:	Build King - SK ecoplant Joint Venture
Location of Work:	
- District :	Yau Tsim Mong
- Affected TPUs :	225

# Details of work:

Details Location of Work	Date & Time	Date & Time Details of work program
Construction Site at Kansu Street Between Ferry Street and Battery Street, Yau Ma Tei Kowoon	Start:: 09/03/2023 01:00 End:: 09/03/2023 06:00	TTA Implementation 2. Construction Activities 3. Road Reinstatement

Name of company Build King - SK ecoplant Juonducting the work: title of char Tat Kwan/ Construct person: Fax number: 98416845	Company Details (Contact):	(Contact):
	Name of company conducting the work:	Build King - SK ecoplant Joint Venture
	Name & title of responsible person :	Char Tat Kwan/ Construction Manager
	Fax number :	
	Telephone number :	98416845
Email: leo.lee@buildking.hk	Email:	leo.lee@buildking.hk

Project	Central Kowloon	Route, Yau Ma Tei	East Section
Complaint Code	EC071-CKRYMT		East Section
Complaint description		complained about	the construction noise from the project site on 10
Parameter	Construction Noise		
Investigation finding			he construction noise of rebar colliding at site area n 10 Mar 2023 at around 1417.
	near Yau Ma Tei identified. The sit	Car Park Building te area near Yau I	ar handling work was being carried out at the site g. Therefore, location generating noise cannot be Ma Tei Car Park Building, i.e. P6 and P7 <sup>1</sup> , was ring the concerned period, as confirmed by the
	investigation period manual and Section a) Sequential construction b) All machine	od with reference in 3.2 of CNMMP (ally operating noise on activities to the N	ave been implemented by the contractor in the to the suggestion listed in the approved EM&A Rev.16.1) which includes:  y equipment to alleviate noise impacts from NSRs ould be shut down when they are not in use to
	manual and CNM		lated requirements by the Contractor for EM&A d that there was no non-compliance of the Project tion site.
Actions taken / to be taken	I	d followed EM&A ze nuisance to the p	Manual strictly to implement mitigation measures ublic.
	In view of public taken:	concerns, the foll	owing preventative measures were taken / to be
	<ul> <li>Provide training to frontline staff about proper handling of construction materials</li> <li>Works location of the concerned area</li> </ul>		
Remarks (Shown in next page)	1. Works loc	ation of the concern	ned area
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho	
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K	
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy 2.	
Date	15 March	2023	

概令銀行才 Bangkok Bank B EK Nar Ruby Co 車百 OK. Œ 平安大組〇 彌敦道 • 型坊街 休憩花園 03 Cheong Yuen Lau 題 **Concerned Area** 編象路4854號 485a Nathan Road Le Chateau 銀腳 甘鹽田 報資大廈 Arts Mansion 層阻熔器大概 K.k Centre ● 新華地天后聯 ● 1864年的時報者台灣軍 永星大廈 Œ 革命中心 rdan Place 斯昌大政 Fu Cheong Building 取效移物等額別の Silka Seaview Flotel - Hong Kong 113 吕茂大庶 Cheang Mow Building Jade Market, Jordan 玉石製商品攤販電车的庫 0 中華工 上海街 甘霖大康 Kum Lam Building 太極軒279 Chi Residences 279 • 上海街 (3 Yau Ma Tei Jockey Club 永智大學 Wing Sheung Building 西爾西 B B M A M Chee Sun Building 思坊街 治無地部中 JMs Tel Market 西九龍走廊 新春年的衛龍田教物學 Nau Ma Teil Onthodomic Clinic 金路衛園 Jolly Garden 0 中華基督教會 灣仔堂基營小學 Chuetof Christ in Chri 参昇大型 Dickson Building 百老匯電影中心□ 回車機 嚴發花圓 0 重素劑 0 要要花园S座 Prosperous Garden Block 5 0 廣東道 ß 東班回春東方祖祭神校 Tung Koon District Society Fong Shu... 阿達 養験花間4序 Prosperous Garden Block 4 医協長者安居資源中心 Housing Society Elderly 恩坊街 新春機制 Yau Ma Tei Police Station 甘爾街 坐動器細力部 Yaumatei Electric Substation 裝毀花圈停車場 9 Prosperous Garden Car Park Prosperous Garden Block 1 駿松花園1座 職器花園2座 Prosperous Garden Block 2 0 製製花園3座 Prosperous Garden Block 3 治動地天主教小學 Yaumati Catholic Primary School 潭平街 Œ 渡船街 潛平街 渡船街 漫平街 渡船街 海船艇 街 Ferry St 文昌街公園 龍物公園 Street Park Per Garden 渡船街天橋 西九龍走廊 製器配 Hau Cheung St

Remark 1: Works location of the concerned area

During	C	D 4 . 37 . 3 f . 72 . 1	Eart Carting
Project Complaint Code		Route, Yau Ma Tei	East Section
Complaint Code Complaint description	EC072-CKRYMT		the construction main from the construct it. 12
Complaint description		complained about ound 1929 to 0031	the construction noise from the project site on 13
Danamatan	Construction Noise		
Parameter			
Investigation finding	at site area P1¹ fro  According to the operated on 13 Ma area at 13 Mar 202  According to cont the bridge and for conducting over rothe formwork may user. Immediate roconcrete pouring concrete joints for formation of concrete works and was structural integrity was completed arpouring work, site	wideos provided by ar 2023 at 1929 and 23 2209 and noise was reactor information, rowork was found and section of Kansov drop down to the epairing of the forwork was not concrete joints requires I not covered by effect of the bridge, concound 2130, as show clearance was concerned.	the construction noise from the concrete pump truck 29 to 14 Mar 2023 0031.  The complainant, concrete pump truck was being d 2055. Workers were moving materials in the site was observed at 14 Mar 2023 0031.  Concrete was being poured into the formwork of destructive. Since the concrete pouring work was a Street with heavy traffic flow, the concrete inside road section of Kansu Street which endangers road mwork was carried out from 1830 to 2045 while appleted yet. There would be unavoidably several the pour could not be finished in one go. However, and ling of timber, which is Prescribe Construction fective CNP at that area. In order to ensure the crete pouring work was resumed around 2045 and with the complainant videos. After the concrete inducted from 13 Mar 2023 2130 to 14 Mar 2023
	0031. NO PIVIES OF	r PC ws were condu	acted during the site clearance.
			orks were not covered by any granted CNP.
Actions taken / to be taken			oncerns, the following preventative measures were
	taken / to be taken		
	equipment		struction work deferred due to malfunction of re-arrange the works to ensure the CNP conditions
	• In case of	f emergency repair	ring required, make use of any noise mitigation pols use to avoid excessive noise emissions;
		•	ion work properly and allow buffer time in case of
	emergency		
			taff to ensure their understanding and awareness of
D 1		NP conditions.	
Remarks	1. Works loc	ation of the concern	ned area
(Shown in next page)			
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho	
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K	
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy2.	
Date	22 March	2023	


概令銀行才 Bangkok Bank B EK Nar Ruby Co 車百 OK. Œ 平安大理〇 彌敦道 • 無法 本意在 Public Square Streer Rest Garden 03 Cheong Yuen Lau 图 創語機 編象路4854號 485a Nathan Road Le Chateau 銀腳 拉爾班 報資大廈 Arts Mansion 層阻熔器大概 K.k Centre 油脂技術中超大酶 Yaumatei Carpark Building ● 新華地天后聯 ● 1864年的時報者台灣軍 永星大廈 Œ 革命中心 rdan Place 警司大廠 Fu Cheong Building 取效移物等額別の Silka Seaview Flotel - Hong Kong Jade Market, Jordan 玉石製商品響聚館特的舞蹈 吕茂大庶 Cheang Mow Building 架器利油需地社區中心 Henry G. Leong Yau Ma Tel Community Centre 中華工 上海街 甘霖大康 Kum Lam Building 太極軒279 Chi Residences 279 製物街 • 上海街 (3 他田衛 Kim Tin Building 永智大學 Wing Sheung Building The concerned area 問題語 B B M A M Chee Sun Building 思坊街 治無地部中 JMs Tel Market 西九龍走廊 是整体出版都比其僅供 introductionic Clinic 金路衛園 Jolly Garden 0 中華基留教會 選仔堂基施小學 Church of Christ in Chri 0 機界大型 Dickson Building 百老匯電影中心□ 回車機 嚴發花圓 0 watells See Prosperous Garden Block 5 0 廣東道 • 東班回春東方祖祭神校 Tung Koon District Society Fong Shu... 阿油 養製作器4序 Prosperous Garden Block 4 医協長者安居資源中心 Housing Society Elderly 思坊街 新春機制 Yau Ma Tei Police Station 甘爾田 坐動器細力部 Yaumatei Electric Substation 裝毀花圈停車場 Prosperous Garden Car Park Prosperous Garden Block 1 駿雪花園1座 職器花園2座 Prosperous Garden Block 2 0 製製花園3座 Prosperous Garden Block 3 治動地天主教小學 Yaumati Catholic Primary School 潭平街 Œ 澄平街 渡船街 渡船街 漫平街 渡船街 海船艇 街 Ferry St 文昌街公園 龍物公園 Street Park Per Garden 渡船街天橋 西九龍走廊 製器配 Hau Cheung St

Remark 1: Works location of the concerned area

Project		Route, Yau Ma Tei	East Section
Complaint Code	EC073-CKRYMT		
Complaint description	The complainant 0700 to 0900.	complained about	the construction noise from the project site from
Parameter	Construction Nois	e	
Investigation finding		s concerned about et and Reclamation	the construction noise of at the site area between Street.
Actions taken / to be taken	contractor of Cent and Reclamation S name plate post re at the area between In view of no cons out of the site bo complaint was con	ral Kowloon Route Street. The concern pairing works cond in Public Square Struction works con- undary of Central included as non-relat	•
Actions taken / to be taken	taken:	e noise mitigation m	lowing preventative measures were taken / to be neasures recommended in CNMMP are proper
Remarks (Shown in next page)		ation of the concern of the concerned a	
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho	
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K	
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Manoly 2.	
Date	21 March	2023	


概令銀行才 Bangkok Bank B EK Nar Ruby Co 車百 OK. Œ 平安大理〇 彌敦道 • 概括版 本意在圖 Public Square Street Rest Canden 03 Cheong Yuen Lau 图 創版機 編象路4854號 485a Nathan Road Le Chateau 銀腳 拉爾班 報資大廈 Arts Mansion 層阻熔器大概 K.k Centre 油脂技術中超大酶 Yaumatei Carpark Building ● 新華地天后聯 ● 1864年的時報者台灣軍 余星大廈 Œ 革命中心 rdan Place 部局大廠 Fu Cheong Building **Concerned Area** 取进移用等置进的 Silka Seaview Hotel - Hong Kong Jade Market, Jordan 玉石製商品攤販賣车的商品 中華工 上海街 甘霖大康 Kum Lam Building • 上海街 (3 熙坊街 Yau Ma Tei Jockey Club 会田 Wim Tin Building 永智大學 Wing Sheung Building ChiR 配圖語 B B M 大瀬 Chee Sun Building 治無地部中 JMs Tel Market 限坊街 西九龍走廊 金級衛園 Jolly Garden 新春年的衛龍田教物學 Nau Ma Teil Onthodomic Clinic 0 中華基督教會 灣仔堂基道小學 Chuethof Christ in Chri 百老匯電影中心 参昇大型 Dickson Building 回車機 嚴發花圓 0 watells See Prosperous Garden Block 5 重素劑 0 廣東道 ß 東班回春東方祖祭神校 Tung Koon District Society Fong Shu... 阿達 養験花間4序 Prosperous Garden Block 4 医協長者安居資源中心 Housing Society Elderly 恩坊街 新春機制 Yau Ma Tei Police Station 甘爾街 坐製器調力站 Yaumasei Electric Substation 裝毀花圈停車場 9 Prosperous Garden Car Park Prosperous Garden Block 1 駿雪花園1座 職器花園2座 Prosperous Garden Block 2 0 製製花園3座 Prosperous Garden Block 3 治動地天主教小學 Yaumati Catholic Primary School 潭平街 Œ 澄平街 渡船街 渡船街 漫平街 渡船街 海船艇 街 Ferry St 文昌街公園 龍物公園 Street Park Per Garden 渡船街天橋 西九龍走廊 製器配 Hau Cheung St

Remark 1: Works location of the concerned area

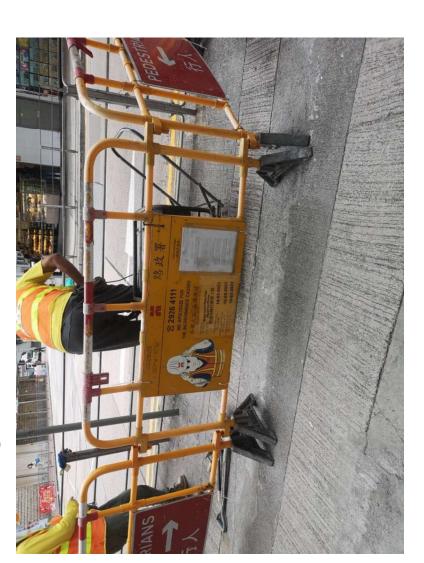

Remark 1: Site photo of the concerned area

Project	Central Kowloon I	Route, Yau Ma Tei	East Section	
Complaint Code		TE20230330_001, H		
Complaint description		complained about	the construction noise from the project site on 29	
Parameter	Construction Noise	e		
Investigation finding	The complaint was 2023 at around 20		ne construction noise at site area Zone C <sup>1</sup> on 29 Mar	
	operating and wo		aplainant complained that a crawler crane was being g beyond normal working hours with video. No led.	
	storm drainpipe, in under "Record of of incident, worke water intrusion thr areas which may urgent repairing w	nside a cofferdam a Emergency Work I rs were carrying or ough the leaked pip endanger the work	water leakage was observed at a 1800mm diameter at Zone C. This incident had been reported to EPD During Restricted Hours" system <sup>2</sup> . During the time at tidy up works inside the cofferdam. Continuous be may cause unstable of the cofferdam and nearby ters, pedestrians and the adjacent traffic, and thus rawler crane was used to lift materials inside the	
Actions taken / to be taken	Emergency Work In view of compli	During Restricted I ance and public co	vorks had been reported to EPD under "Record of Hours" system. oncerns, the following preventative measures were	
	use of El immediate	unscheduled emerge PD reporting syste lly;	ency works required to address safety concern, make em for emergency works and report the works	
	<ul><li>measures a</li><li>Plan the d</li><li>emergency</li></ul>	and control of the to ay-to-day construct y; and	ring required, make use of any noise mitigation pols use to avoid excessive noise emissions; ion work properly and allow buffer time in case of	
		training to frontline staff to ensure their understanding and awareness of		
Remarks	•	EPD's reporting system for emergency works.  Works location of the concerned area		
(Shown in next page)			uring restricted hours	
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho		
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K		
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy 2.		
Date	6 April 20	23		

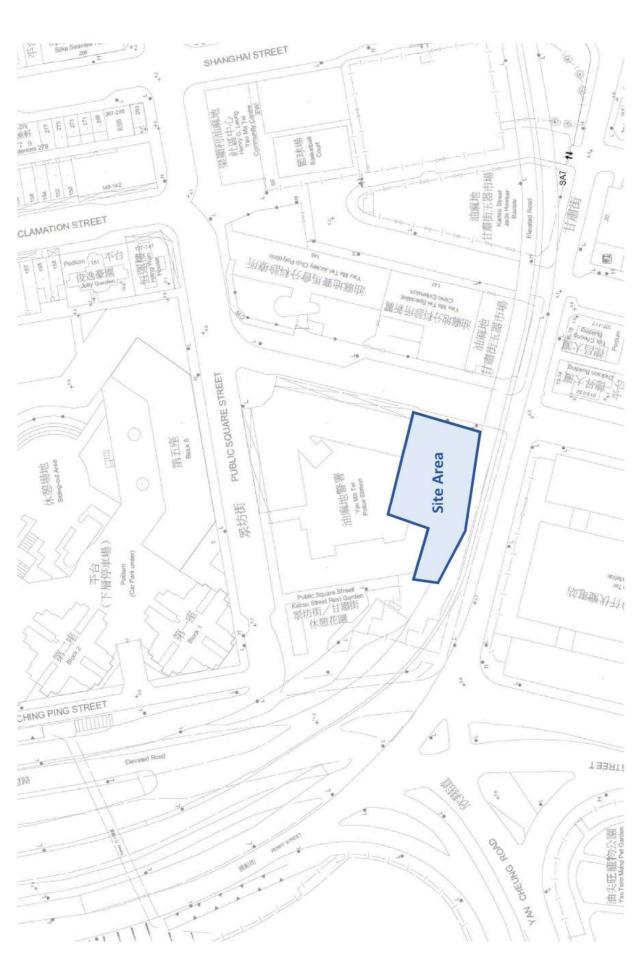

Remark 1: Works location of the concerned area

# Remark 2: Record of emergency work during restricted hours

2023/4/6 下午1:11

Mail - Lee Wan Chung, Leo - Outlook

[Acknowledgement] Record for Emergency Construction Work: 2023-03-29 19:30

Record of Emergency Work During Restricted Hours <admin@nco-emergencywork.hk>

To: Lee Wan Chung, Leo <leo.lee@buildking.hk>

Allow sender | Block sender CAUTION: This email originated from outside of the company. DO NOT click links or open attachments unless you recognise the sender

This email acknowledges your Record for Emergency Construction Work submitted at 07:39 on 04/04/2023. Information appended below:

Date and time of receiving notification:	04/04/2023 15:39:15
Record Reference :	20230404-001
From:	Build King - SK ecoplant Joint Venture
Name & Post of PIC/Contact Person :	Eric Mak/ Construction Manager
Telephone :	91773554
Fax:	
Email:	leo.lee@buildking.hk
Date of work:	2023-03-29 19:30
HyD Emergency Serial Number :	
Police ref:	
Name of Contractor :	Build King - SK ecoplant Joint Venture
Description and justification of Emergency Work	Water leakage was observed at a 1800mm dia. storm drain pipe, inside a cofferdam at construction site. Continuous seawater intrusion through the leaked pipe may cause flooding of the cofferdam and nearby areas which may endancer the workers.
	pedestrians and the adjacent traffic, and thus urgent repairing work is required
Location of work:	
district:	Yau Tsim Mong
- Affected TPUs:	225

Details Location of Work   Dat	te & Time	Date & Time Details of work program
Start::  Construction site at Kansu 19:30 Street near Yau Ma Tel Police End:: Station 29:003	Start:: 29/03/2023 19:30 End:: 29/03/2023	1. Preparation works 2. Delivery of cement bags 3. Mixing of cement 4. Pipe sealing up

2023/4/6 下午1:11

Mail - Lee Wan Chung, Leo - Outlook

List of PME used and/or PCW carried out :	Crawler crane
Noise control measure implemented :	
Noise barrier provided? :	ON
Noise barrier details:	
If no, why? :	not applicable
Is hand-held breaker used? ?	NO
If yes, what type?:	
Is Noise barrier provided for hand-held breaker? : NO	ON
If no. why?:	


Project	Central Kowloon Route, Yau Ma Tei East Section				
Complaint Code	EC075 -CKRYMTE20230330_002				
Complaint description	The complainant complained about the construction noise from the project site and site area between Public Square Street and Reclamation Street at 14 Mar 2023 0100 and 14 Mar 2023 0715.				
Parameter	Construction Noise				
Investigation finding	The complainant concerned about the construction noise from the project site at 14 Mar 2023 0100 and the construction noise site area between Public Square Street and Reclamation Street at 14 Mar 2023 0715.				
Actions taken / to be taken	According to contractor information, no works was conducted by the contractor at 14 Mar 2023 0100 and 14 Mar 2023 0715. No works was conducted by the contractor of Central Kowloon Route, Yau Ma Tei East Section at Public Square Street and Reclamation Street. The concerned construction works were suspected to be street name plate post repairing works conducted by another contactor <sup>2</sup> , which was conducted at the area between Public Square Street and Reclamation Street.  In view of no construction works conducted by the Contractor during restricted hour and the concerned area during daytime is out of the site boundary of Central Kowloon Route - Yau Ma Tei East Section, the complaint was concluded as non-related to this Project.  In view of public concerns, the following preventative measures were taken / to be taken:				
	Ensure the noise mitigation measures recommended in CNMMP are proper implemented				
Remarks	Works location of the concerned area				
(Shown in next page)	2. Site photo of the concerned area				
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho			
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K			
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy 2.			

6 April 2023

Date

概令銀行才 Bangkok Bank B EK Nar Ruby Co 車百 OK. Œ 平安大理〇 彌敦道 • 概括版 本意在圖 Public Square Street Rest Canden 03 Cheong Yuen Lau 图 創版機 編象路4854號 485a Nathan Road Le Chateau 銀腳 拉爾班 報資大廈 Arts Mansion 層阻熔器大概 K.k Centre 油脂技術中超大酶 Yaumatei Carpark Building ● 新華地天后聯 ● 1864年的時報者台灣軍 余星大廈 Œ 革命中心 rdan Place 部局大廠 Fu Cheong Building **Concerned Area** 取进移用等置进的 Silka Seaview Hotel - Hong Kong Jade Market, Jordan 玉石製商品攤販賣车的商品 中華工 上海街 甘霖大康 Kum Lam Building • 上海街 (3 熙坊街 Yau Ma Tei Jockey Club 会田 Wim Tin Building 永智大學 Wing Sheung Building ChiR 配圖語 B B M 大瀬 Chee Sun Building 治無地部中 JMs Tel Market 限坊街 西九龍走廊 金級衛園 Jolly Garden 新春年的衛龍田教物學 Nau Ma Teil Onthodomic Clinic 0 中華基督教會 灣仔堂基道小學 Chuethof Christ in Chri 百老匯電影中心 参昇大型 Dickson Building 回車機 嚴發花圓 0 watells See Prosperous Garden Block 5 重素劑 0 廣東道 ß 東班回春東方祖祭神校 Tung Koon District Society Fong Shu... 阿達 養験花間4序 Prosperous Garden Block 4 医協長者安居資源中心 Housing Society Elderly 恩坊街 新春機制 Yau Ma Tei Police Station 甘爾街 坐製器調力站 Yaumasei Electric Substation 裝毀花圈停車場 9 Prosperous Garden Car Park Prosperous Garden Block 1 駿雪花園1座 職器花園2座 Prosperous Garden Block 2 0 製製花園3座 Prosperous Garden Block 3 治動地天主教小學 Yaumati Catholic Primary School 潭平街 Œ 澄平街 渡船街 渡船街 漫平街 渡船街 海船艇 街 Ferry St 文昌街公園 龍物公園 Street Park Per Garden 渡船街天橋 西九龍走廊 製器配 Hau Cheung St

Remark 1: Works location of the concerned area

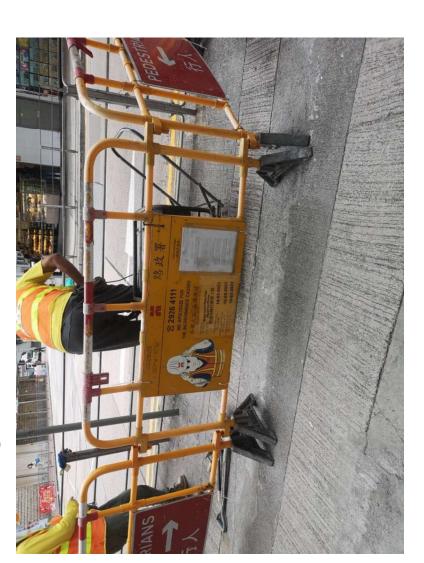

Remark 1: Site photo of the concerned area