
Vol. 3 of 5 FEP-03/457/2013/D Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 September 2023





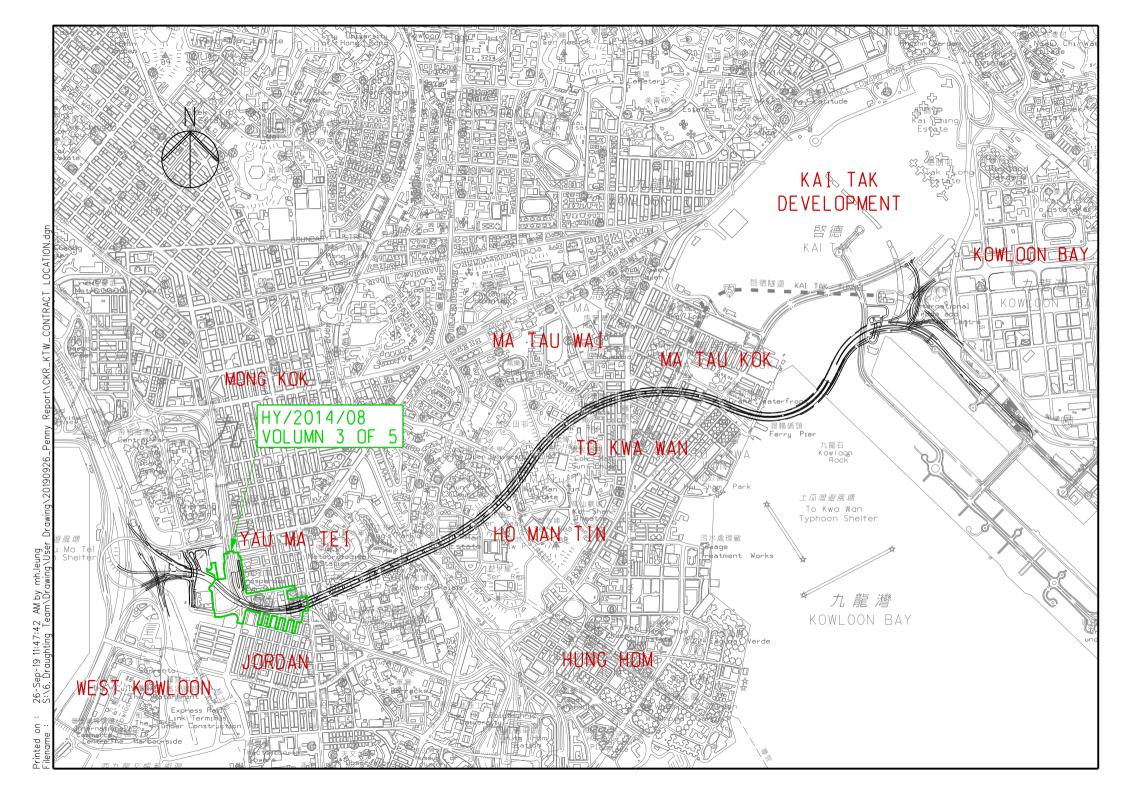

Environmental Permit No. EP-457/2013/D

Central Kowloon Route

Independent Environmental Checker Verification

Reference Document/Plan	
Document/ Plan to be Certified / Verified:	Monthly EM&A Report No.66 (September 2023)
Date of Report:	10 October 2023
Date received by IEC:	10 October 2023

Yau Ma Tei East (HY/2014/08)

Reference EP Condition

Works Contract:

Environmental Permit Condition: 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

IEC Verification

Mondy 20.

I hereby verify that the above referenced document/plan complies with the above referenced condition of EP-457/2013/D.

Ms Mandy To

Date: 10 October 2023

Independent Environmental Checker

Our ref: 0436942_IEC Verification Cert_YMTE_Monthly EM&A Rpt No.66.docx





Build King – SK ecoplant Joint Venture

Central Kowloon Route Contract HY/2014/08 Section of Yau Ma Tei East

Monthly EM&A Report No. 66

(Period from 1 to 30 September 2023)

Rev. 1 (10 October 2023)

	Name	Signature
Prepared by	Kako H.L. Ho (Assistant Environmental Consultant)	Ho
Checked & Reviewed by	Y.H. Law (Senior Environmental Consultant)	Malan
Approved & Certified by	Kevin W. M. Li (Environmental Team Leader)	K

TABLE OF CONTENTS

EXECUTIVE SUMMARY

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	. 10
3.	MONITORING RESULTS	. 13
1 .	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	. 21
5.	EM&A SITE INSPECTION	. 23
6.	FUTURE KEY ISSUES	. 24
7.	CONCLUSION AND RECOMMENDATIONS	. 25

LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

EXECUTIVE SUMMARY

- A.1 Build King SK ecoplant Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 66th monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 September 2023 to 30 September 2023.
- A.2 A summary of the construction works reported by Main Contractor for the Project during the reporting month is listed below.

Construction Activities undertaken

- Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B-WB1
- Excavation and Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Bottom Slab at Zone B EB2
- Excavation and Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Underpinning Works and Bottom Slab at Zone C
- Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Slab, Underpinning Works and Bottom Slab at Zone D
- Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, D-wall construction, install kingposts/recharge well/observation well/pumping well and Pumping Test at Zone B3 & F
- Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G
- Construct Right-line Gascoigne Road Flyover Deck, Demolish Existing Gascoigne Road Flyover and Construct Right-line Gascoigne Road Flyover Deck Segments
- Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts, PMMA panel, ventilators, BS works of noise enclosure at Zone 3
- Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2
- Demolition of Car Park Building
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

Regular construction noise monitoring during normal working hours

W-N1A, W-P11, W-N18, W-N25A

5 times

Construction dust (24-hour TSP) monitoring

W-A1 5 times W-A6 5 times

Construction dust (1-hour TSP) monitoring

W-A1, W-A6 15 times

A.4 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 15 and 28 September 2023. Details of the audit findings and

implementation status are presented in Section 5.

- A.5 Joint weekly site inspections were conducted by representatives of the Environmental Team (ET), Contractor and Engineer on 7, 15, 21 and 28 September 2023. One joint site inspection with IEC was also undertaken on 15 September 2023. Details of the audit findings and implementation status are presented in Section 5.
- A.6 Details of waste management are presented in Section 3.
- A.7 Two Action Level of construction noise was triggered during the reporting month as documented complaints were received. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Level of 24-hour TSP and 1-hour TSP was recorded in the reporting month.
- A.8 A total of four environmental complaint was received in the reporting month. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- A.9 No non-compliance was reported in the reporting month.
- A.10 No notification of summon or prosecution was received in this reporting month.
- A.11 A summary of the construction activities provided by Main Contractor in the next reporting month is listed below:

Construction Activities to be undertaken

- Construct Plant Room, Grouting/Mass fill Inside Plant Room, Construct In-situ RC wall (N1 wall) and construct bottom slab at the transition between Zone A & B Eastbound
- Excavation down to ceiling slab at Zone EB1, EB2 and C1
- Ceiling slab and waling beam B4 construction at C2
- Rock excavation and underpinning works at Zone C3 & D1
- Construct bottom slab and side walls from bottom slab to ceiling slab at Zone D2/D3
- Complete D-wall construction at Zone B3
- Complete D-wall construction and construct temporary buttress wall at Zone F
- Complete D-wall construction, install king posts, temporary supports to DN1000 & 400kV cables, DN1200 & 2xDN600 storm drainage, install steel buttress wall and 132kV CLP cable diversion at Zone G
- Bridge Works:
 - i.Continue demolition of existing Gascoigne Road Flyover
 - ii. Construct deck segments by FT for deck P5R downhill side
 - iii.Install F/T on P4R
- Continue erection of main beams and secondary tie beams for Noise Enclosure F02 in Zone 3 (night works)
- Works at Zone 2 Noise Enclosure scheduled as the following:
 - i.Column E Column erection upon the approval/implementation of TTA for the delivery of steel column

Construction Activities to be undertaken

- ii.Columns G Continue the Excavation and Lateral Support works for pile cap construction
- iii.Columns C Install steel footing
- Noise Enclosure steelworks fabrication at Fabrication Yard in Zhuhai, China
- Monitoring of instrumentation for all areas

1. Basic Project Information

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was applied for and the EP (EP-457/2013/C) was issued by EPD on 16 January 2017. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/D) was issued by EPD on 15 June 2021. A Further EP (FEP-03/457/2013/D) was issued by EPD on 5 November 2021.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
 - Section of Yau Ma Tei East
 - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
 - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
 - iii. Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
 - iv. Demolition and re-provisioning of Gascoigne Road Flyover and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
 - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route Tunnel Electrical & Mechanical contract
 - vi. Design and construction of Noise Barrier Works
 - vii. Prepare temporary traffic arrangement proposals, discuss at Traffic Management Liaison Group meeting and obtain its agreement and approval/endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Construction Activities undertaken

- Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B-WB1
- Excavation and Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Bottom Slab at Zone B EB2
- Excavation and Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Underpinning Works and Bottom Slab at Zone C
- Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Slab, Underpinning Works and Bottom Slab at Zone D
- Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, D-wall construction, install kingposts/recharge well/observation well/pumping well and Pumping Test at Zone B3 & F
- Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G
- Construct Right-line Gascoigne Road Flyover Deck, Demolish Existing Gascoigne Road Flyover and Construct Right-line Gascoigne Road Flyover Deck Segments
- Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts, PMMA panel, ventilators, BS works of noise enclosure at Zone 3
- Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2
- Demolition of Car Park Building
 - 1.5. The project organisational chart specifying management structure and contact details are shown in Appendix C.
 - 1.6. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2.

Table 1.2 Summary of the Status of Valid Environmental Licence

Notification, Permit and Documentations

Permit/ Licences/	Valid Period				
Notification	From	То	Status	Remark	
/Reference No.	FIOIII	То			
Environmental Permit					
EP-457/2013/D	15 Jun 2021	End of Project	Valid	-	
Further Environmental I	Permit				
FEP-03/457/2013/D	5 Nov 2021	End of Project	Valid		
Wastewater Discharge Li	Wastewater Discharge License				
WT00043433-2023	17 Mar 2023	31 Mar 2028	Valid	-	
Notification of Constructi	on Works under	the Air Pollution	n Control (Construc	tion Dust) Regulation	
471691	14 Sep 2021	End of Project	Notified	-	
Chemical Waste Producer Registration					
WPN5213-225-B2526-01	14 Mar 2018	End of Project	Valid	-	
Billing Account for Disposal of Construction Waste					
7029997	1 Feb 2018	End of Project	Valid	-	
Construction Noise Permi	Construction Noise Permit				

Permit/ Licences/ Valid Period				
Notification /Reference No.	From	То	Status	Remark
GW-RE1021-23	19 Aug 2023	18 Nov 2023	Valid	Construction Noise Permit for Bridge Works at Shanghai Street
GW-RE0370-23	16 Apr 2023	15 Oct 2023	Valid	Construction Noise Permit at Multi-storey Carpark Building
GW-RE0590-23	15 Jun 2023	14 Sep 2023	Superseded by GW-RE1079-23	Construction Noise
GW-RE1079-23	15 Sep 2023	14 Dec 2023	Valid	Permit at Zone D
GW-RE0711-23	19 Jun 2023	15 Dec 2023	Valid	Construction Noise Permit at Methadone Clinic
GW-RE1055-23	1 Sep 2023	29 Sep 2023	Expired during reporting month	Construction Noise Permit for FT & EGRF Demolition at Shanghai Street
GW-RE0769-23	1 Jul 2023	30 Sep 2023	Expired during reporting month	Construction Noise Permit at Zone A & B1
GW-RE0864-23	26 Jul 2023	25 Sep 2023	Superseded by GW-RE1079-23	Construction Noise Permit at Zone C
GW-RE1166-23	26 Sep 2023	25 Dec 2023	Valid	
GW-RE1046-23	1 Sep 2023	31 Oct 2023	Valid	Construction Noise Permit for EGRF Demolition at Temple Street
GW-RE0896-23	4 Aug 2023	31 Oct 2023	Valid	Construction Noise Permit at Zone B3 & F
GW-RE0940-23	3 Aug 2023	30 Sep 2023	Expired during reporting month	Construction Noise Permit for Erection of Enclosure at Zone 3
GW-RE0912-23	8 Aug 2023	29 Sep 2023	Expired during reporting month	Construction Noise Permit for Road Resurfacing
GW-RE1009-23	23 Aug 2023	31 Oct 2023	Valid	Construction Noise Permit for Pier Demolition and Formtraveller Launching at Battery Street
Marine Dumping Permit				
EP/MD/24-006	2 May 2023	1 Nov 2023	Valid	Type 1 – Open Sea Disposal
EP/MD/24-034	23 Aug 2023	22 Sep 2023	Expired during reporting month	Type 1 – Open Sea Disposal (Dedicated Site) & Type 2 - Confined Marine Disposal

2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/D) and FEP (FEP-03/457/2013/D) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/D and FEP-03/457/2013/D for the Project

EP/FEP Condition (EP-457/2013/D) (FEP-03/457/2013/D)	Submission	Submission date
Condition 3.4	Monthly EM&A Report (August 2023)	14 September 2023

2.2. Details of the major construction activities reported by Main Contractor in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Construction activities undertaken	Remarks on progress
 Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B-WB1 	• 98% completion
 Excavation and Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Bottom Slab at Zone B EB2 	• 46% completion
 Excavation and Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Underpinning Works and Bottom Slab at Zone C 	• 51% completion
 Lateral Support works/Excavation, Install Hanger Supports, Construct Roof, Ceiling Slab, Underpinning Works and Bottom Slab at Zone D 	• 57% completion
 Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, D-wall construction, install kingposts/recharge well/observation well/pumping well and Pumping Test at Zone B3 & F 	• 82% completion
 Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G 	• 82% completion
 Construct Right-line Gascoigne Road Flyover Deck, Demolish Existing Gascoigne Road Flyover and Construct Right-line Gascoigne Road Flyover Deck Segments 	• 65% completion
 Construct socketed H-piles, pile caps, ground beams, RC columns and erect steel posts, PMMA panel, Ventilators, BS Works of Noise Enclosure at Zone 3 	• 65% completion
 Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2 	• 78% completion
Demolition of Car Park Building	Completed

2.3.	The drawing showing the project layout and the location of the monitoring station and
	environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates
	of the monitoring location are shown in Table 2.3.

Table 2.3 Summary for the location of the monitoring station

Monitoring Location	Location ID	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)*	W-A1/ W-N1A	22.31345	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

Remark: *The High Volume Sampler (HVS) at dust impact monitoring location W-A1 had been relocated on 6 Sep 2022 due to installation work of PV panel at Yau Ma Tei Catholic Primary School. The relocation of HVS was approved by ER and agreed with IEC.

3. MONITORING RESULTS

3.1. Monitoring Parameters

Air Quality

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

Noise

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 3.2. Monitoring Equipment

Air Quality

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificates of dust monitoring equipment are attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
	LD-5R Digital Dust Indicator	0Z4545	1 Mar 2023
1-hour TSP	LD-5R Digital Dust Indicator	992820	1 Mar 2023
1-nour 1SP	PC-3A(E) Digital Dust Indicator	JC2002225	9 Oct 2022
	PC-3A(E) Digital Dust Indicator	JC2110287	9 Oct 2022
	TE-5170X High Volume	1084	5 Sep 2023 and
	Sampler		22 Sep 2023
24-hour TSP	TE-5170X High Volume	1050	5 Sep 2023 and
	Sampler		22 Sep 2023
	TE-5028A Calibration Kit	3702	31 Mar 2023

Table 3.1 Construction Dust Monitoring Equipment

Noise

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.
- 3.2.6. Acoustic calibrators and sound level meters using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

Monitoring Equipment	Serial Number	Date of Calibration
Nti XL2 Sound Level Meter	A2A-13663-F0	15 Feb 2023
Rion NC-75 Sound Level Calibrator	35124527	2 Nov 2022

Table 3.2 Monitoring Equipment Used in Monitoring

3.3. Monitoring Methodology and QA/QC results

Air Quality

- 3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R and PC-3A(E) digital dust indicator) were used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- ◆ The HVS was set at the monitoring location, with electricity supply connected and secured;
- ♦ HVS was calibrated before commencing the 1st measurement;
- ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- The airflow over time during sampling process was recorded by the HVS.

3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:

- ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- ◆ No furnace or incinerator flues was nearby;
- ◆ Airflow around the sampler was unrestricted; and
- Permission could be obtained to set up the samplers and gain access to the monitoring station.

3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- ◆ The filter holder and area surrounding the filter were cleaned:
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 0.64-1.52m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6-1.7m³min⁻¹);

- ◆ The programmable timer was set for a sampling period of 24 hours, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.

Noise

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}) in decibels dB(A). $L_{Aeq(30min)}$ was used as the monitoring metric for the time period between 0700 -1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms⁻¹ or wind with gusts exceeding 10 ms⁻¹. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms⁻¹.

3.4. Monitoring Locations

Air Quality

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favourable for monitoring and the access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tei Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Table 3.3 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
W-A1	Yau Ma Tei Catholic Primary School (Hoi Wang Road)
W-A6	Man Cheong Building

Noise

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring stations are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

Table 3.4 Noise Monitoring Stations

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade
W-N18	Hydan Place	Façade
W-N25A	Prosperous Garden Block 1	Façade
W-P11	The Coronation Tower 1	Façade

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

Impact Duration **Sampling Parameter Frequency Monitoring** 1-hour continuous 1-hour TSP Dust 3 times per six days measurement 24-hour continuous Dust 24-hour TSP Once per six days sampling 30-minute continuous $L_{eq 30 min}$, Noise Once per week (0700 - 1900)measurement L₁₀ and L₉₀ as reference.

Table 3.5 Summary of Impact Monitoring Programme

3.6. Result Summary

Air Quality

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are summarised in Table 3.6.

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source	
W-A1	Nearby traffic	
W-A6	Nearby traffic	

- 3.6.2. Air quality impact monitoring for the reporting month was carried out on 6, 12, 18, 23 and 29 September 2023.
- 3.6.3. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.7 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(µg/m³)	Action Level(µg/m3)	Limit Level(µg/m3)
W-A1	54 – 69	319	500
W-A6	54 - 70	306	500

Table 3.8 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(µg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	28 - 69	167	260
W-A6	27 - 65	166	260

Noise

3.6.4. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

Monitoring Station	Major Noise Source
W-N1A	Nearby traffic
W-N18	Nearby traffic
W-N25A	Nearby traffic
W-P11	Nearby traffic

Table 3.9 Observation at Noise Monitoring Stations

- 3.6.5. The construction noise impact monitoring for the reporting month was carried out on 6, 12, 18, 23 and 29 September 2023.
- 3.6.6. The result for noise monitoring is summarized in Table 3.10. The measurement data are shown in Appendix M.

Time Monitoring Range, dB(A) **Parameter** Period location **Action Level** Limit Level# \mathbf{L}_{eq} L_{10} L_{90} 70dB(A) or 65 W-N1A* 72.7 - 73.455.1 - 56.864.8 - 66.2dB(A) during examination 68.7 - 69.974.2 - 75.663.7 - 65.0W-N18 Normal When one working Leq documented hour from 30min complaint is 0700-1900 received W-N25A 55.1 - 57.166.3 - 68.168.7 - 69.475dB(A)# W-P11 63.8 - 68.969.4 - 71.055.2 - 65.5

Table 3.10 Summary of Noise Monitoring Results

Remarks:

- 1. # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.
- 2. * No examination was scheduled at Yau Ma Tei Catholic Primary School during the monitoring dates. The limit level of W-N1A would be 70 dB(A).

Waste management

3.6.7. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.11 Quantities of waste generated from the Project

	Quantity					
		Non-inert C&D Materials				
			Others, e.g.	Recy	ycled material	s
Reporting period	Inert C&D Materials (in 'tonnes)	ls Waste	General Refuse disposed	Paper/card board (in '000 Kg)	Plastics (in '000 Kg)	Metals (in '000 Kg)
Sep 2023	17159.90	0.00	114.60	0.00	0.00	6.50

4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

Complaint Received via Project Hotline	Complaint Received via 1823 or from other government departments		
Contractor notify ER, ET and IEC	ER notify Contractor, ET and IEC		
	pt onto the complaint database. Contractor, ER and ET to vestigation of complaint		
If complaint is considered not valid	If complaint is found valid		
ET or ER to reply the complainant if necess	Contractor to identify and implement remedial measures in consultation with the IEC, ET and ER.		
	The ER, ET and IEC to review the effectiveness of the Contractor's remedial measures and the updated situation; ET to undertake additional monitoring and audit to verify the situation if necessary, and oversee that circumstances leading to the complaint do not recur. ER to conduct further inspection as necessary.		
If the complaint is referred by the EPD, the Contractor to prepare interim report on the status of the complaint investigation and follow-up actions stipulated above, including the details of the remedial measures and additional monitoring identified or already taken, for submission to EPD within the time frame assigned by the EPD			

The ET to record the details of the complaint, results of the investigation, subsequent actions taken to address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Event and Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. Two Action Level of construction noise was triggered during the reporting month as documented complaints were received. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Level of 24-hour TSP and 1-hour TSP was recorded in the reporting month.
- 4.4. A total of four environmental complaints was received in the reporting month. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- 4.5. No non-compliance was reported in the reporting month.
- 4.6. No notification of summon and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, four (4) site inspections were carried out on 7, 15, 21 and 28 September 2023, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 15 and 28 September 2023.
- 5.2. One joint site inspection with IEC also undertaken on 15 September 2023. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

Date Environmental Observations		Follow-up Status		
7 September 2023	 Cement bags should be properly covered at Zone D. Environmental license should be properly displayed at Zone A. 	 Cement bags had been properly covered. Environmental license had been properly displayed. 		
1. Waste should be disposed at Zone A. 2. Drip tray should be provided for chemical containers at Zone B2 and P5.		 Waste had been disposed to landfill. Drip tray and chemical storage cage had been provided. 		
21 September 2023	Drip tray should be provided for chemical containers at Zone D.	Chemical containers had been removed.		
28 September 2023	 Drip tray should be provided for chemical containers at Zone A, Zone B1 and P5. Cement mixing platform should be covered at 3 sides and top at Zone C. 	 Chemical containers had been removed. Cement mixing platform had been covered at 3 sides and top. 		

Table 5.1 Site Observations

- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.

6. FUTURE KEY ISSUES

6.1. The construction activities provided by Main Contractor in the next reporting month are:


Construction Activities to be undertaken

- Construct Plant Room, Grouting/Mass fill Inside Plant Room, Construct In-situ RC wall (N1 wall) and construct bottom slab at the transition between Zone A & B Eastbound
- Excavation down to ceiling slab at Zone EB1, EB2 and C1
- Ceiling slab and waling beam B4 construction at C2
- Rock excavation and underpinning works at Zone C3 & D1
- Construct bottom slab and side walls from bottom slab to ceiling slab at Zone D2/D3
- Complete D-wall construction at Zone B3
- Complete D-wall construction and construct temporary buttress wall at Zone F
- Complete D-wall construction, install king posts, temporary supports to DN1000 & 400kV cables, DN1200 & 2xDN600 storm drainage, install steel buttress wall and 132kV CLP cable diversion at Zone G
- Bridge Works:
 - i.Continue demolition of existing Gascoigne Road Flyover
 - ii.Construct deck segments by FT for deck P5R downhill side
 - iii.Install F/T on P4R
- Continue erection of main beams and secondary tie beams for Noise Enclosure F02 in Zone 3 (night works)
- Works at Zone 2 Noise Enclosure scheduled as the following:
 - i.Column E Column erection upon the approval/implementation of TTA for the delivery of steel column
 - ii.Columns G Continue the Excavation and Lateral Support works for pile cap construction
 - iii.Columns C Install steel footing
- Noise Enclosure steelworks fabrication at Fabrication Yard in Zhuhai, China
- Monitoring of instrumentation for all areas
- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.
- 6.3. The tentative schedule of regular construction noise, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.

7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 66th monthly EM&A Report presents the EM&A works undertaken during the period from 1 September 2023 to 30 September 2023 in accordance with the EM&A Manual and the requirement under EP- 457/2013/D and FEP-03/457/2013/D.
- 7.2. Two Action Level of construction noise was triggered during the reporting month as documented complaints were received. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Level of 24-hour TSP and 1-hour TSP was recorded in the reporting month.
- 7.3. A total of four environmental complaint was received in the reporting month. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- 7.4. No non-compliance was reported in the reporting month.
- 7.5. No notification of summons or prosecution was received in the reporting month.
- 7.6. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Environmental Monitoring & Auditing
Zirvitoimivitai Vitoimioting of I Marking
A A
Appendix A
Alignment and Works Area For the Contract No.
HY/2014/08

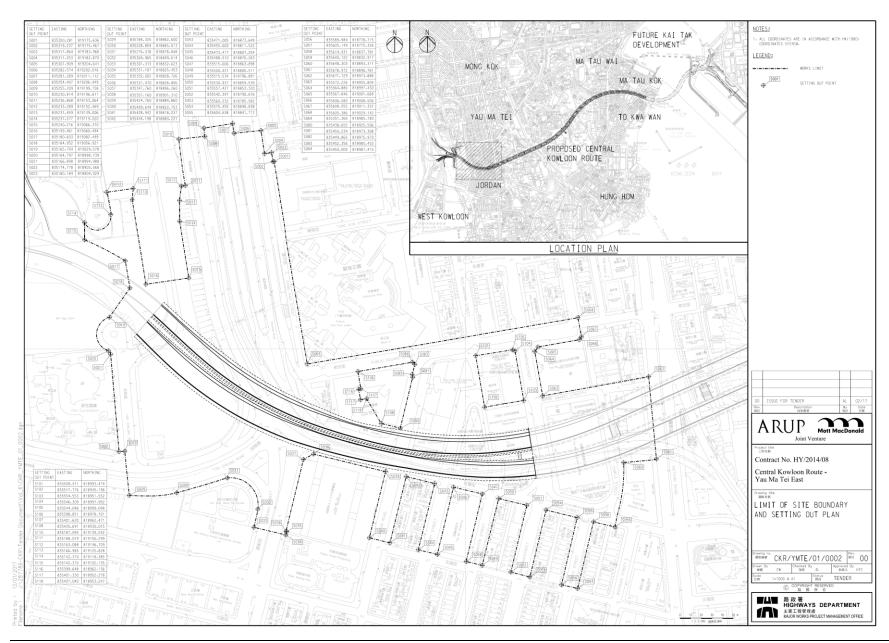





Appendix B Construction Programme



Contract No. HY/2014/08 Environmental Monitoring & Auditing
Appendix C
Project Organization Chart

Project O-Chart

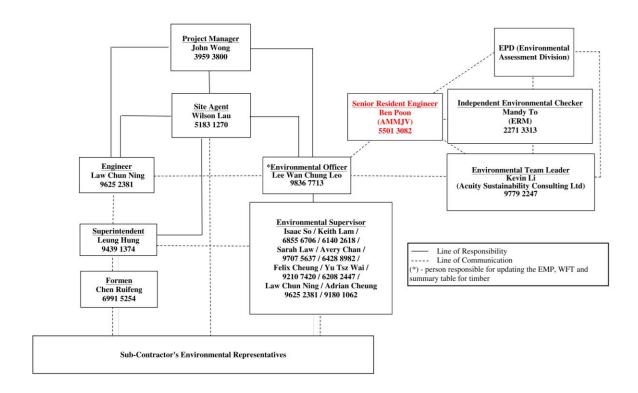

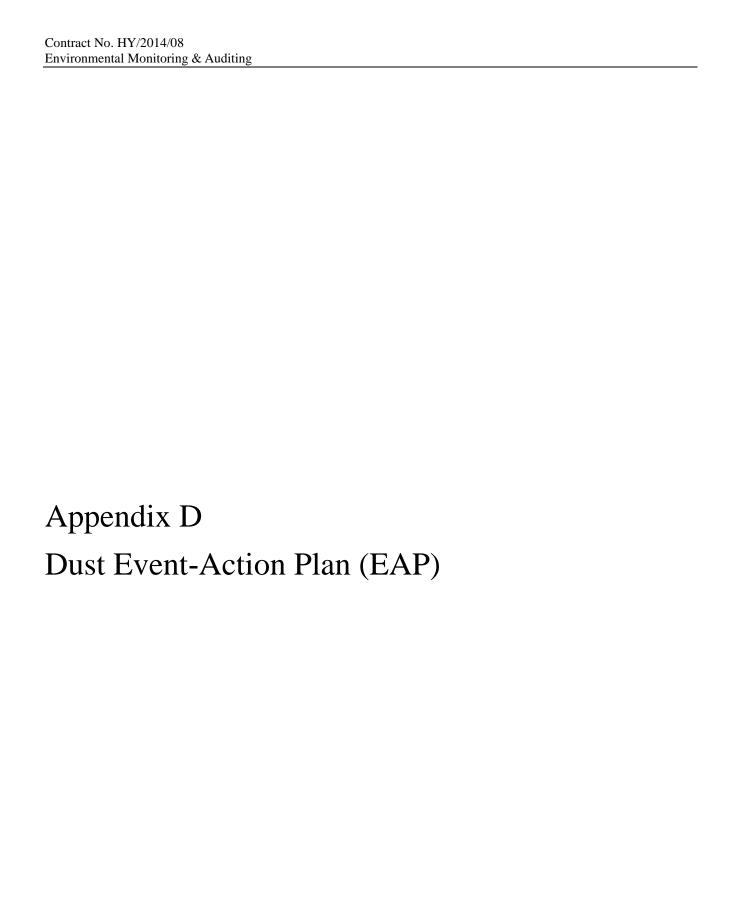

EVENT	ACTION				
EVENI	ET	IEC	ER	CONTRACTOR	
ACTION LEV	EL				
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily.	 Check monitoring data submitted by ET; Check Contractor's working method. 	1. Notify Contractor.	 Rectify any unacceptable practice; Amend working methods if appropriate. 	
2.Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 	
LIMIT LEVEL	_		1	1	
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform ER, Contractor and	 Check monitoring data submitted by ET; Check Contractor's working method; 	Confirm receipt of notification of failure in writing; Notify Contractor;	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC	


EVENT	ACTION			
EVENI	ET	IEC	ER	CONTRACTOR
	 EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	3. Ensure remedial measures properly implemented.	within 3 working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.
2.Exceedance for two or more consecutive samples	 Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

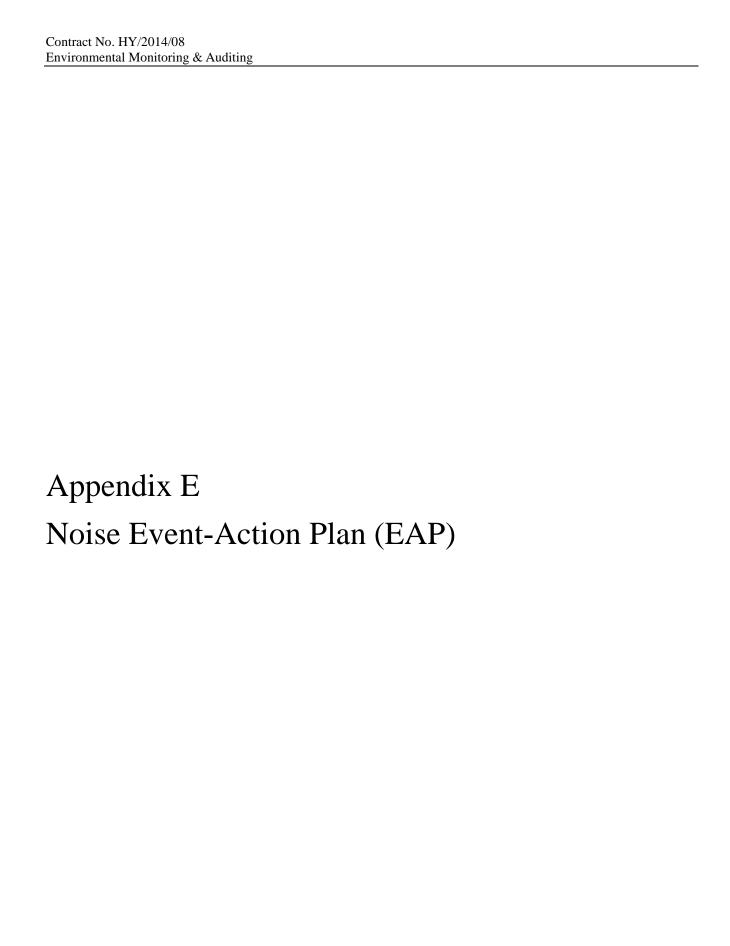

EVENT		ACTIO	ACTION					
	ET	IEC	ER	CONTRACTOR				
Action Level	 Identify source, investigate the causes of exceedance and propose remedial measures; Notify IEC and Contractor; Report the results of investigation to the IEC, ER and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness. 	 Review the analysed results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented 	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.				
Limit Level	 Identify source; Inform IEC, ER, EPD and Contractor; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, ER and EPD the causes and actions taken for the exceedances; Assess effectiveness of Contractor's remedial actions 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated. 				


EVENT	ACTION							
	ET	IEC	ER	CONTRACTOR				
	and keep IEC, EPD and ER informed of the results;		abated.					
	8. If exceedance stops, cease additional monitoring.							

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative

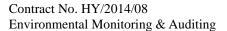

Appendix F
Environmental Mitigation Implementation
Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent ction Dust Impact	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$4.3.10	D1	The contractor shall follow the procedures and	Minimize dust	Contractor	All	Construction stage	• APCO	Implemented
		requirements given in the Air Pollution Control (Construction Dust) Regulation	impact at the nearby sensitive receivers		construction sites	-	To control the dust impact To meet HKAQO and TM-EIA criteria	·
S4.3.10	D2	 Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m² to achieve the dust removal efficiency. 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	Implemented
\$4.3.10	D3	 Proper watering at exposed spoil should be undertaken throughout the construction phase; Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; A stockpile of dusty material should not be 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		extended beyond the pedestrian barriers, fencing or traffic cones; The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle. Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period; The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S4.3.10	D6	 continuously; Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; Any skip hoist for material transport should be totally enclosed by impervious sheeting; Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. Implement regular dust monitoring under EM&A programme during the construction stage. 	Monitoring of dust impact	Contractor	Selected rep. dust monitoring	Construction stage	• TM-EIA	• Implemented
			Construct	tion Noise (Airborn	station			

Acuity Sustainability Consulting Ltd.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	 Implement the following good site practices: Only well-maintained plant should be operated onsite and plant should be serviced regularly during the construction programme; Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; Mobile plant should be sited as far away from NSRs as possible and practicable; Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities. 	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
S5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	Annex 5, TM- EIAO	Implemented
\$5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all construction	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM- EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM- EIAO	Implemented
\$5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor ity (Construction P	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

Water Quality (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.1	W1	In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following: Construction Runoff • At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction; • The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates; • The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of						
		0.1 m3/s a sedimentation basin of 30 m3 would be						
		required and for a flow rate of 0.5 m3/s the basin						
		would be 150 m3. The detailed design of the sand/						
		silt traps shall be undertaken by the contractor						
		prior to the commencement of construction;						
		All exposed earth areas should be completed and						
		vegetated as soon as possible after earthworks						
		have been completed, or alternatively, within 14 days of the cessation of earthworks where						
		practicable. Exposed slope surfaces should be						
		covered by tarpaulin or other means;						
		The overall slope of the site should be kept to a						
		minimum to reduce the erosive potential of surface						
		water flows, and all traffic areas and access roads						
		protected by coarse stone ballast. An additional						
		advantage accruing from the use of crushed stone						
		is the positive traction gained during prolonged						
		periods of inclement weather and the reduction of						
		surface sheet flows;						
		All drainage facilities and erosion and sediment						
		control structures should be regularly inspected						
		and maintained to ensure proper and efficient						
		operation at all times and particularly following						
		rainstorms. Deposited silt and grit should be						
		removed regularly and disposed of by spreading						
		evenly over stable, vegetated areas;						
		Measures should be taken to minimize the ingress						
		of site drainage into excavations. If the excavation						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system; Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers; Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes; All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing facilities should be provided at every construction						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains; Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain; Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts; All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby; Adopt best management practices; All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to January) as far as practicable.						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S6.9.1.2	W2	 Tunneling Works and Underground Works Cut-&-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to January) as far as practicable. Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge; The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater; Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries. 	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-DSS TM-EIAO	• Implemented
S6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance TM-DSS	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		responsible for appropriate disposal and maintenance.						
S6.9.1.5	W4	 No direct discharge of groundwater from contaminated areas should be adopted. A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly recharged into the ground. If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an 	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	Water Pollution Control Ordinance TM-DSS TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers. • If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater to be recharged) to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol interceptor.						
S6.9.1.6		Accidental Spillage In order to prevent accidental spillage of chemicals, the following is recommended:	To minimize water quality impact from accidental	Contractor	All construction site where practicable	Construction stage	Water Pollution Control Ordinance	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains; The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings. Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation.	spillage				 ProPECC PN 1/94 TM-EIAO TM-DSS 	
			Waste Manage	ement (Construction	Waste)			
\$7.4.1	WM1	Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM2	batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.	Good site	Contractor	All	Construction stage	• Land	• Implemented
37.3.1	77.72	 Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and 	practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	construction sites	Sonstruction stage	(Miscellaneo us Provisions) Ordinance • Waste Disposal Ordinance • ETWB TCW No. 19/2005	- implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction.						
S7.5.1	WM3	 Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage; The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage. 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land (Miscellaneo us Provisions) Ordinance Waste Disposal Ordinance ETWB TCW No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM5	 All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location; All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the excess materials shall never be dumped into the sea except at the approved locations; Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action. The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations and copies of such records shall be submitted to the engineers; The Contractors shall comply with the conditions in the dumping licence. 	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material; The material shall be placed into the disposal pit by bottom dumping; Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site; Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site. For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal. 						
\$7.5.1	WM6	 Chemical Waste Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in 	Control the chemical waste and ensure proper storage,	Contractor	All construction sites	Construction stage	Waste Disposal (Chemical Waste)	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes; Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation; The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated; Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD. 	handling and disposal				(General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM7	 General Refuse General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes; A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible; Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance	Implemented, deficiency rectified after observation
		scheme should be considered by the contractor.	Land Contamin	ation				
S8.9 & Appendix 8.4	LC2	Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant. The excavated contaminated soils would be stockpiled at designated area on site and covered by sheet to prevent dispersion of contamination	The contaminated soil will be excavated for on-site reuse	Contractor	РВН4	Prior to commencement of construction works within the contaminated area	Practice Guide (PG) for Investigation and Remediation of Contaminate d Land	Implemented

EIA Ref.	EM&A Log Ref.	Reco	mmended Mitiga	tion Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		during stockpiling. The Contractor should pay attention to the selection of suitable groundwater lowering schemes and discharge points if the groundwater table is higher than the contaminated soils during excavation. The Contractor should also obtain a valid Water Pollution Control Ordinance (WPCO) discharge licence from EPD where applicable.							Guidance Notes for Contaminate d Land Assessment and Remediation Guidance	
S8.9 & Appendix 8.4	LC3	 Following completion of the excavation to the specified depth, at least one sample from the base of the excavation and four samples evenly distributed along the boundary of the excavation shall be taken for a closure assessment testing. The acceptance criterion is shown below: 						Manual for Use of Risk- Based Remediation Goals (RBRGs) for Contaminate	Implemented	
		Locations Testing requirement Criteria PBH4 PCBs RBRGs (Public Park) • If the results of analysis below the RBRGs (Public Park), no further excavation will be required. If the analysis indicates presence of contamination (i.e. noncompliance of the acceptance criteria), further excavation shall be carried out in 0.5m increment vertically and/or horizontally depending on the location(s) of the sample(s) which has exceeded the acceptance criteria. Further sampling shall also be conducted for compliance testing. The process of							d Land Management	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
Appendix 8.4	LC4	excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist. A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No						Implemented
		construction/development works shall be carried out prior to the endorsement of the RR by EPD.						
				Hazard to Life				
S9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6,	Н3	The explosives delivery trucks should be approved by	To comply with	Contractor	-	Construction stage	Dangerous	• N/A
para.8		Mines Division and should meet the regulatory requirements for transport of explosives.	the requirements for approval of an explosives				Goods Ordinance	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			delivery vehicle					
S9.10, para.7 and S9.18	H4	Blast cover should be provided for shaft at HMT, and kept closed during blasting. Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.						
S9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
Landscape & Visual								
S10.10.1 Table 10.11	LV3	Good Site Management Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent landscape areas and vegetation, and to create a neat and tidy visual appearance.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance. 						
S10.10.1 Table 10.11	LV4	Screen Hoarding Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	Lighting Control during Construction All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV6	Erosion Control The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation • Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval in due course in accordance with ETWB TC no. 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	• 'Guidelines for Tree Risk Management and Assessment Arrangement on an Area Basis and on a Tree Basis', Greening,	Implemented


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1 Table 10.11	LV8	Tree Transplantation ● For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	Landscape and Tree Management (GLTM) Section, DEVB Latest recommende d horticultural practices from GLTM Section, DEVB ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB	• N/A

S10.10.1 Table 10.11 S10.10.1 Table 10.11 S10.10.1 S1	EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
Table 10.11 • For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006. • Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting								2/2004	
but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process.	Table	LV9	 For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006. Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application 	impact and also enhance	Contractor	1	Construction stage	3/2006 • Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB • ETWB TCW	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures The contractor should be alerted during the	Objectives of the Recommende d Measures & Main Concerns to address To preserve any	Implementation Agent Contractor	Location / Timing	Implementation Stage Construction stage	Requirements and/ or standards to be achieved	Implementation Status • Implemented
		construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	cultural heritage items which may be removed and damaged by the excavation		construction works for cut and cover tunnels	· ·	requirements	
S12.6.1	CH3	 Protective covering should be provided for the buildings in the form of plastic sheeting; Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding; An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams; The AAA settlement and tilting limit should be 6/8/10 mm and1/2000, 1/1500 and 1/1000; Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment; 	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance. 						
\$12.6.1		 Adopting diaphragm wall construction method; Grout curtain should be provided in front of the building; Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table; the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000; Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;. Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance. 	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented
S12.6.1 Table 12.2		 The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment. 	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR- 02)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							Proposed Vibration Limits	
				EM&A Project				
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented
S13.2-13.4	EM2	 An Environmental Team needs to be employed as per the EM&A Manual; Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures; An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with. 	Perform environmental monitoring & auditing	Highways Department/ Contractor	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented

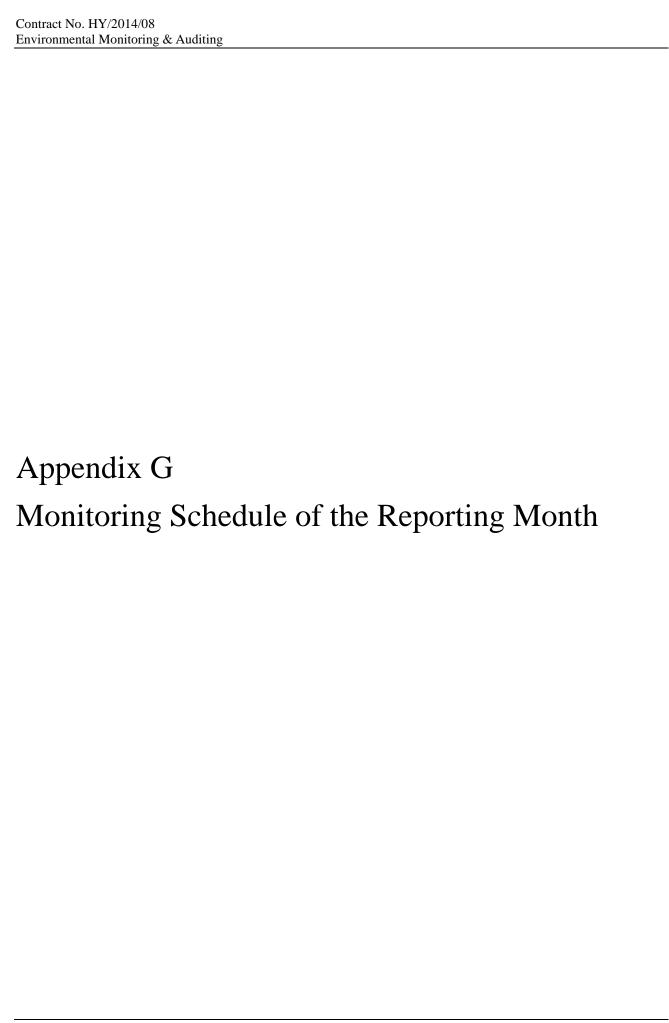

Impact Monitoring Schedule for YMTE										
	Sep-23									
Sun	Mon	Tue		Thu	Fri	Sat				
					1	2				
		-		_						
3	4	5	6 Impact	7	8	9				
			Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A,							
			W-P11,W-N18 & W-N25A							
10	11		13	14	15	16				
		Impact								
		Air monitoring for W-A6 &W-A1								
		Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A								
		W 111,W NIO & W NEDI								
17	18	19	20	21	22	23				
	Impact					Impact				
	Air monitoring for W-A6 &W-A1					Air monitoring for W-A6 &W-A1				
	Noise monitoring for W-N1A,					Noise monitoring for W-N1A,				
	W-P11,W-N18 & W-N25A					W-P11,W-N18 & W-N25A				
24	25	26	27	28	Impact	30				
					Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A,					
					W-P11,W-N18 & W-N25A					

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix H
Calibration Certificates
(Air Monitoring)





Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Information of Calibrated Equipement

		to	2-Mar-23	Next Verification Test Date:	1-Mar-24
Unit-under-Test- Model No.:		Sibata LD-5R			
Unit-under-Test Serial No.:		0Z4545			
Our Report Refrence No.:	RF	PT-23-HVS-0002	2		
Calibration Location:			E	max	

Standard Equipment Information


Verification Equipment Type:	Tisch TSP HVS	Tisch HVS Calibrator
Standard Equipment Model No.:	TE-5170X	TE-5025A
Equipment serial no.:	1086	3465
Last Calibration Date:	1-Mar-23	28-Jun-22
Next Calibration Date:	30-Apr-23	27-Jun-23

Equipement Vertification Result

Verification			Duration		Results from	Calibrated Equipement	Results from Standard Equipment	
Test No.	Date	Start-time	End-time	Elapsed Time (in min)	Total Counts	Counts/ Minute x-axis	Dust Concentration (µg/m³) y-axis	
1	1/3/2023	5013.27	5016.34	184.20	4851	26	78	
2	1/3/2023	5016.34	5019.34	180.00	6000	33	96	
3	1/3/2023	5019.34	5022.34	180.00	7740	43	129	
4	2/3/2023	5022.34	5025.34	180.00	3840	21	62	
5	2/3/2023	5025.34	5028.34	180.00	2400	13	38	
6	2/3/2023	5028.34	5031.34	180.00	3420	19	55	

Linear Regression of y on x



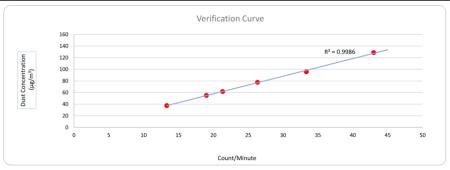

Operated By:

Andy Li Project Technician, Environmental

Date: 01-03-2023

Checked By:

Tandy Tse
Senior Consultant, Environmental

Date: 01-03-2023





Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Information of Calibrated Equipement

Verification Test Date:	1-Mar-23	to	2-Mar-23	Next Verification Test Date:	1-Mar-24
Unit-under-Test- Model No.:		Sibata LD-5R			
Unit-under-Test Serial No.:		992820			
Our Report Refrence No.:	R	PT-23-HVS-0001			
Calibration Location:			E	nax	

Standard Equipment Information


_		Standard Equipment innorm	ation	
	Verification Equipment Type:	Tisch TSP HVS	Tisch HVS Calibrator	
١	Standard Equipment Model No.:	TE-5170X	TE-5025A	
١	Equipment serial no.:	1086	3465	
١	Last Calibration Date:	1-Mar-23	28-Jun-22	
ı	Next Calibration Date:	30-Apr-23	27-Jun-23	

Equipement Vertification Result

	Equipement Vertification Result											
Verification			Duration		Results from	Calibrated Equipement	Results from Standard Equipment					
Test No.	Date	Start-time	End-time	Elapsed Time (in min) Total Counts		Counts/ Minute x-axis	Dust Concentration (μg/m³) y-axis					
1	1/3/2023	5013.27	5016.34	184.20	4728	26	78					
2	1/3/2023	5016.34	5019.34	180.00	5760	32	96					
3	1/3/2023	5019.34	5022.34	180.00	7800	43	129					
4	2/3/2023	5022.34	5025.34	180.00	3780	21	62					
5	2/3/2023	5025.34	5028.34	180.00	2280	13	38					
6	2/3/2023	5028.34	5031.34	180.00	3300	18	55					

Linear Regression of y on x



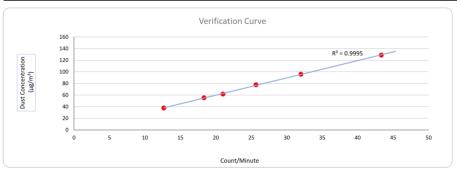

Operated By:

Andy Li
Project Technician, Environmental

Date: 01-03-2023

Checked By:

Tandy Tse WAY

Date: 01-03-2023







Tel.: (852) 2698 635 Fox.: (852) 2698 958

PC-3A(E) K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 9-Oct-22 to 16-Oct-22

 Next Verification Test Date:
 15-Oct-23

 Unit-under-Test- Model No.
 PC-3A(E)

 Unit-under-Test Serial No.
 JC-2110287

 Our Report Refrence No.
 RPT-22-HVS-0023

Standard Equipment Information		
Verification Equipment Type	Tisch TSP HVS	Tisch HVS Calibrator
Standard Equipment Model No.	TE-5170X	TE-5025A
Equipment serial no.	MFC 1049	3465
Last Calibration Date	28-Sep-22	28-Jun-22
Next Calibration Date	28-Nov-22	29-Jun-23

Verification	Date .		Time		K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	9/10/2022	6210.34	6213.34	180.00	0.00092	37.00	6660	R221670/1	34
2	9/10/2022	6213.34	6216.36	181.20	0.00096	68.33	12382	R221670/2	66
3	9/10/2022	6216.36	6221.78	325.20	0.00097	106.33	34580	R221670/3	103
4	16/10/2022	6249.91	6252.92	180.60	0.00096	56.00	10114	R221671/1	54
5	16/10/2022	6252.92	6255.92	180.00	0.00103	85.67	15420	R221671/2	88
6	16/10/2022	6255.92	6261.94	361.20	0.00101	81.67	29498	R221671/3	83
					0.00098				

K-Factor to be inputted in PC-3A(E) (corrected 1 decimal point):

1.0

By Linear Regression of y on x:

slope, mh= 1.0270 intercept,ch= -3.1658 *Correlation Coefficient,R= 0.9960

Verification Test Result: Strong Correlation, Results were accepted.


* If the Correlation Coefficient, R is <0.5. Checking and Re-

verification are required.

Verified By: __

Field Supervisor

Date: 19-10-2022

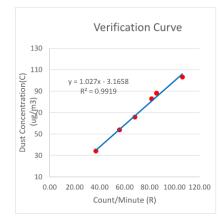









PC-3A(E) K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 9-Oct-22 to 16-Oct-22

Next Verification Test Date: 15-Oct-23
Unit-under-Test- Model No. PC-3A(E)
Unit-under-Test Serial No. JC-2002225
Our Report Refrence No. RPT-22-HVS-0021

Standard Equipment Information		
Verification Equipment Type	Tisch TSP Tisch HVS HVS Calibrator	
Standard Equipment Model No.	TE-5170X TE-5025A	
Equipment serial no.	MFC 1049 3465	
Last Calibration Date	28-Sep-22 28-Jun-22	
Next Calibration Date	28-Nov-22 29-Jun-23	

Verification	Date	57	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)				
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	9/10/2022	6210.34	6213.34	180.00	0.00073	47.00	8460	R221670/1	34
2	9/10/2022	6213.34	6216.36	181.20	0.00101	65.00	11778	R221670/2	66
3	9/10/2022	6216.36	6221.78	325.20	0.00124	83.00	26992	R221670/3	103
4	16/10/2022	6249.91	6252.92	180.60	0.00096	56.00	10114	R221671/1	54
5	16/10/2022	6252.92	6255.92	180.00	0.00126	69.67	12540	R221671/2	88
6	16/10/2022	6255.92	6261.94	361.20	0.00122	67.67	24441	R221671/3	83
					0.00107				

K-Factor to be inputted in PC-3A(E) (corrected 1 decimal point):

By Linear Regression of y on x:


slope, mh= 1.9898 intercept,ch= -57.4924 *Correlation Coefficient,R= 0.9774

Verification Test Result: <u>Strong Correlation, Results were accepted.</u>
* If the Correlation Coefficient, R is <0.5. Checking and Reverification are required.

Verified By:

Field Supervisor

Date: 19-10-2022

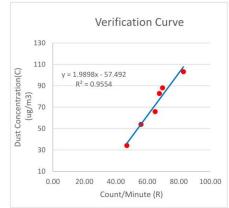



RECALIBRATION DUE DATE:

March 31, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: March 31, 2023

Calibration Model #: TE-5028A

Rootsmeter S/N: 438320

Ta: 294

°K

Operator: Jim Tisch

II IISCII

Calibrator S/N: 3702

Pa: 748.54

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3110	4.1	1.50
2	3	4	1	1.0280	6.7	2.50
3	5	6	1	0.9340	8.1	3.00
4	7	8	1	0.8680	9.4	3.50
5	9	10	1	0.6580	16.2	6.00

		Data Tabula	tion		
Vstd	Qstd	$\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)
0.9929	0.7573	1.2237	0.9945	0.7586	0.7676
0.9894	0.9624	1.5798	0.9910	0.9641	0.9909
0.9875	1.0573	1.7306	0.9892	1.0591	1.0855
0.9858	1.1357	1.8693	0.9874	1.1376	1.1725
0.9767	1.4844	2.4474	0.9784	1.4869	1.5351
	m=	1.68024		m=	1.05214
QSTD[b=	-0.04353	QA	b=	-0.02731
	r=	0.99994	-	r=	0.99994

	Calculation	S	
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
	For subsequent flow rat	e calculatio	ns:
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30.

Fisch Environmental, Inc. 145 South Miami Avenue /illage of Cleves, OH 45002

www.tisch-env.com

TOLL FREE: (877)263-7610 FAX: (513)467-9009





Site Information

One information					
Location:	YMT Catholic Primary School	Site ID:	W-A1	Date:	05-Sep-2023
Serial No:	1084	Model:	TE-5170X	Operator:	Andy Li

Ambient Condition

Actual Pressure during Calibration (P _a)	752.0	Actual Temperature during	302.3
(mm Hg):	752.8	Calibration (T _a) (deg K):	302.3

Calibration Orifice

Model:	TE-5028A	Slope (m _c):	1.68024
Serial No.:	3702	Intercept (b _c):	-0.04353
Calibration Due Date:	31-Mar-24	Corr. Coeff:	0.99994

Calibration Data

Plate or	∆H ₂ O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m³/min)	(chart)	(corrected)
18	6.80	1.560	62.0	61.27
13	5.60	1.418	54.0	53.36
10	4.80	1.314	49.0	48.42
7	3.30	1.094	40.0	39.53
5	2.50	0.956	35.0	34.59

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

43.6380 -7.9151 Corr. Coeff= 0.9963

Calculations


 $Qa = 1/m_c^* [Sqrt (\Delta H_2 O^* (P_a/P_{Std})^* (T_{Std}/T_a)) - b_c]$

 $IC = I^*(Sqrt (P_a/P_{Std})^*(T_{Std}/T_a))$

Qa = actual flow rate IC = corrected chart response I = actual chart response m_c = calibrator slope b_c = calibrator intercept

m = sampler slope b = sampler intercept T_{Std} = 298 deg K P_{Std} = 760 mm Hg

T_a = actual temperature during calibration (deg K) P_a = actual pressure during calibration (mm Hg)

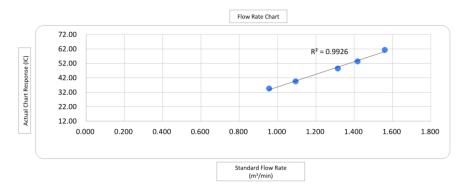

Checked by: Tandy Tse

Date: ___ 05-Sep-2023





Site Information

Location:	Location: Man Cheong Building Site ID: W-A6 Date: 05-Sep-2023					
			7.70.70.70.			
Serial No:	1050	Model:	TE-5170X	Operator:	Andy Li	

Ambient Condition

Actual Pressure during Calibration (Pa)	752.0	Actual Temperature during	302.3
(mm Hg):	752.8	Calibration (T _a) (deg K):	302.3

Calibration Orifice

Model:	TE-5028A	Slope (m _c):	1.68024
Serial No.:	3702	Intercept (b _c):	-0.04353
Calibration Due Date:	31-Mar-24	Corr. Coeff:	0.99994

Calibration Data

Plate or	∆H ₂ O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m³/min)	(chart)	(corrected)
18	6.60	1.537	61.0	60.28
13	5.90	1.454	56.0	55.34
10	5.20	1.367	51.0	50.40
7	4.20	1.231	46.0	45.46
5	2.50	0.956	34.0	33.60

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

Corr. Coeff=


Calculations

Qa = $1/m_c^*[Sqrt (\Delta H_2O^*(P_a/P_{Std})^*(T_{Std}/T_a))-b_c]$ $IC = I*(Sqrt (P_a/P_{Std})*(T_{Std}/T_a))$

Qa = actual flow rate IC = corrected chart response I = actual chart response m_c = calibrator slope b_c = calibrator intercept

m = sampler slope b = sampler intercept T_{Std} = 298 deg K P_{Std} = 760 mm Hg

T_a = actual temperature during calibration (deg K) P_a = actual pressure during calibration (mm Hg)

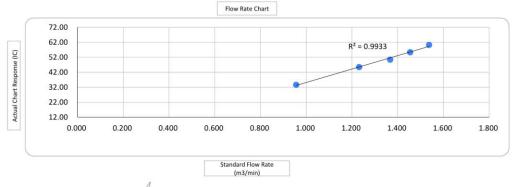

Checked by:_ 05-Sep-2023 Date:





Site Information

	Olto Illiorination				
Location:	YMT Catholic Primary School	Site ID:	W-A6	Date:	22-Sep-2023
Serial No:	1084	Model:	TE-5170X	Operator:	Andy Li

Ambient Condition

Actual Pressure during Calibration (Pa)	757.9	Actual Temperature during	202.4
(mm Hg):	757.9	Calibration (T _a) (deg K):	303.4

Calibration Orifice

Model:	TE-5028A	Slope (m _c):	1.68024
Serial No.:	3702	Intercept (b _c):	-0.04353
Calibration Due Date:	31-Mar-24	Corr. Coeff:	0.99994

Calibration Data

Plate or	∆H ₂ O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test#	(in)	(m³/min)	(chart)	(corrected)
18	12.00	2.066	61.0	60.37
13	9.50	1.841	54.0	53.45
10	7.40	1.628	48.0	47.51
7	5.20	1.369	40.0	39.59
5	3.40	1.112	28.0	27.71

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	33.3686	b= -7.7799	Corr. Coeff=	0.9945

Calculations

Qa = $1/m_c*[Sqrt (\Delta H_2O*(P_a/P_{Std})*(T_{Std}/T_a))-b_c]$

 $IC = I*(Sqrt (P_a/P_{Std})*(T_{Std}/T_a))$


Qa = actual flow rate IC = corrected chart response I = actual chart response m_c = calibrator slope

b_c = calibrator intercept

m = sampler slope b = sampler intercept T_{Std} = 298 deg K P_{Std} = 760 mm Hg

T_a = actual temperature during calibration (deg K)

P_a = actual pressure during calibration (mm Hg)

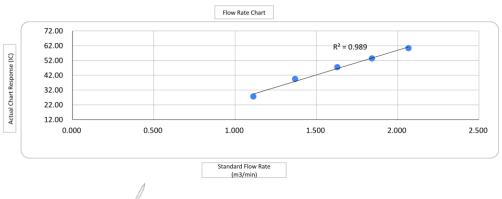

22-Sep-2023 Checked by:_ Date:





Site Information

Location:	Man Cheong Building	Site ID:	W-A6	Date:	22-Sep-2023
Serial No:	1050	Model:	TE-5170X	Operator:	Andy Li

Ambient Condition

and the second s	V-0.00000000000000000000000000000000000	Application of the Control of the Co		
Actual Pressure during Calibration (P _a) (mm Hg):	757.9	Actual Temperature during Calibration (T _a) (deg K):	303.4]

Calibration Orifice

Model:	TE-5028A	Slope (m _c):	1.68024
Serial No.:	3702	Intercept (b _c):	-0.04353
Calibration Due Date:	31-Mar-24	Corr. Coeff:	0.99994

Calibration Data

Plate or	∆H ₂ O	Qa, X-Axis	I, CFM	IC, Y-Axis	
Test #	(in)	(m³/min)	(chart)	(corrected)	
18	11.90	2.058	60.0	59.38	
13	9.90	1.879	57.0	56.42	
10	8.20	1.713	50.0	49.49	
7	5.00	1.343	41.0	40.58	
5	3.10	1.063	35.0	34.64	

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m= 25.6918 b= 6.7069 Corr. Coeff= 0.9950

Calculations

Qa = $1/m_c^*[Sqrt(\Delta H_2O^*(P_a/P_{Std})^*(T_{Std}/T_a)) - b_c]$ IC = $I^*(Sqrt(P_a/P_{Std})^*(T_{Std}/T_a))$

 $IC = I*(Sqrt (P_a/P_{Std})*(T_{Std}/T_a))$

Qa = actual flow rate IC = corrected chart response I = actual chart response m_c = calibrator slope


b_c = calibrator intercept

m = sampler slope b = sampler intercept T_{Std} = 298 deg K

P_{Std} = 760 mm Hg

 T_a = actual temperature during calibration (deg K)

P_a = actual pressure during calibration (mm Hg)

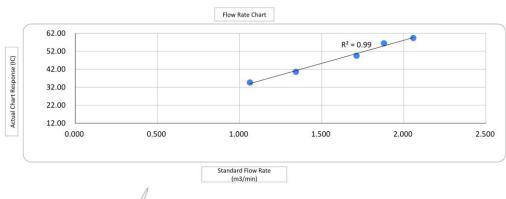

Checked by: _____ Date: _____22-Sep-2023

Environmental Monitoring & Auditing	
A	
Appendix I	
11	
('alibration ('artiticates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	
Calibration Certificates (Noise)	

Contract No. HY/2014/08



Manufacturer Calibration Certificate

The following instrument has been tested and calibrated to the manufacturer specifications. The calibration is traceable in accordance with ISO/IEC 17025 covering all instrument functions.

Device Type:

XL2 Audio and Acoustic Analyzer

· Serial Number:

A2A-13663-F0

· Certificate Issued:

15 February 2023

· Certificate Number:

44972-A2A-13663-F0

· Results:

PASSED

(for detailed report see next page)

Tested by:

M. Frick

Signature:

m alten Riet 102

Stamp:

Li - 9494 Schaan www.nti-audio.com

NTi Audio AG • Im alten Riet 102 • 9494 Schaan • Liechtenstein • Europe • Tel: +423 239 6060 www.nti-audio.com • HR-Nr: 2.012.557 • MwStNr: 54306 • Bank: VP Bank, Vaduz, Acc No: 322.235.015

Calibration of:

XL2 Audio and Acoustic Analyzer

Serial Number:

A2A-13663-F0

Date:

15 February 2023

· Detailed Calibration Test Results:

						actual	XL2	calibration
			reference	actual	unit	error	tolerance	uncertainty ²
	RMS Level @ 1kHz, XLR	? Input	0.1	0.100	V	≤0.1%	±0.5%	±0.10%
	76 20701 @ 1		1	0.999	V	-0.1%	±0.5%	±0.09%
			10	9.982	V	-0.2%	±0.5%	±0.09%
	Flatness, XLR Input1	20 Hz	1	0.995	V	-0.5%	±1.1%	±0.09%
		20 kHz	1	1.003	V	0.3%	±1.1%	±0.09%
	Frequency		1000	1000.00	Hz	≤0.003%	±0.003%	±0.01%
	Residual Noise	XLR		< 2 uV			<2 uV	±0.50%
	THD+N @ 0 dBu, 1 kHz,	XLR Inpu	ut	-100.5	dB		typ100 dB	±0.50%
•	Test Conditions:	Tempe	rature:	24.9	°C			

Relative Humidity:

19.8 %

· Calibration Equipment Used:

- Agilent Multimeter, Typ 34401A, Serial No. MY 5300 4607 Last calibration: 15.09.2022, Next calibration: 15.09.2023 Calibrated by ELCAL to the national standards maintained at Swiss Federal Office of Metrology. SCS 0002
- FX100 Audio Analyzer, Serial No. 10408 Last Calibration: 11.10.2022, Next Calibration: 11.10.2023 Manufacturer calibration based on Agilent 34410, Serial No. MY47014254, Last Calibration: 26.05.2022, Next Calibration: 26.05.2023 which is calibrated by ELCAL to national standards maintained at Swiss Federal Office of Metrology. SCS 002

¹ The specified tolerance +/-0.1 dB @ 1V = +/- 1.1%

² The reported expanded uncertainty is based on a standard uncertainty multiplied by a coverage factor k=2, providing a level of confidence of approximately 95%. The uncertainty evaluation has been carried out in accordance with the regulations of the GUM.

Page 1 of 2

Certificate No. D224644E



CALIBRATION CERTIFICATE

Product : SOUND CALIBRATOR

Type : NC-75 Serial number : 35124527

Manufacturer : RION CO., LTD.

Calibration quantities : Sound pressure level (with reference standard microphone)

Calibration method : Measured by specified secondary standard microphone

according to JCSS calibration procedure specified by RION.

Ambient conditions : Temperature 23.9 °C, Relative humidity 49 %,

Static pressure 100.6 kPa

Calibration date : 02/11/2022 (DD/MM/YYYY)

Calibration location : 3·20·41 Higashimotomachi, Kokubunji, Tokyo 185·8533, Japan

RION CO., LTD. Calibration Room

We hereby certify that the results of this calibration were as follows.

Issue date: 09/11/2022 (DD/MM/YYYY)

Junichi Kawamura

Manager

Quality Assurance Section, Quality Assurance Department, Environmental Instrument Division,

RION CO., LTD.

3-20-41 Higashimotomachi, Kokubunji,

Tokyo 185-8533, Japan

This certificate is based on article 144 of the Measurement Law and indicates the result of calibration in accordance with measurement standards traceable to Primary Measurement Standards (National Standards) which realizes the physical units of measurement according to the International System of Units (SI).

The accreditation symbol is attestation of which the result of calibration is traceable to Primary Measurement Standards (National Standards).

The certificate shall not be reproduced except in full, without the written approval of the issuing laboratory.

The calibration laboratory who issued this calibration certificate conforms to ISO/IEC 17025:2017.

This calibration certificate was issued by the calibration laboratory accredited by IAJapan who is a signatory to the Mutual Recognition Arrangement (MRA) of International Laboratory Accreditation Cooperation (ILAC) and Asia Pacific Accreditation Cooperation (APAC). This (These) calibration result(s) may be accepted internationally through ILAC/APAC MRA.



Page 2 of 2

Certificate No. D224644E

CALIBRATION RESULT

1. Sound pressure level (with reference standard microphone)

Measured	Expanded
value	uncertainty *1
93.99 dB	0.09 dB

Specified secondary standard microphone:

: 4160

Serial number : 2973341

Reference Sound pressure: 2×10-5 Pa

*1 Defines an interval estimated to have a level of confidence of approximately 95 %. Coverage factor k=2

Calibration result is the calibration value in ambient conditions during calibration.

BE OUT OF JCSS CALIBRATION

1. Frequency

Measured value	Measurement uncertainty (k=2)
1000.0 Hz	$2.7 \times 10^{-4} \mathrm{Hz}$

Working measurement standard universal counter:

Type

: 53132A

Serial number : MY40005574

(JCSS Calibration Certificate No. 2208001889940)

2. Total distortion

Measured	
value	
0.2 %	

Working measurement standard distortion meter:


: VA-2230A

Serial number : 11076061

(A2LA Calibration Certificate No. 1502-03109)

· closing ·



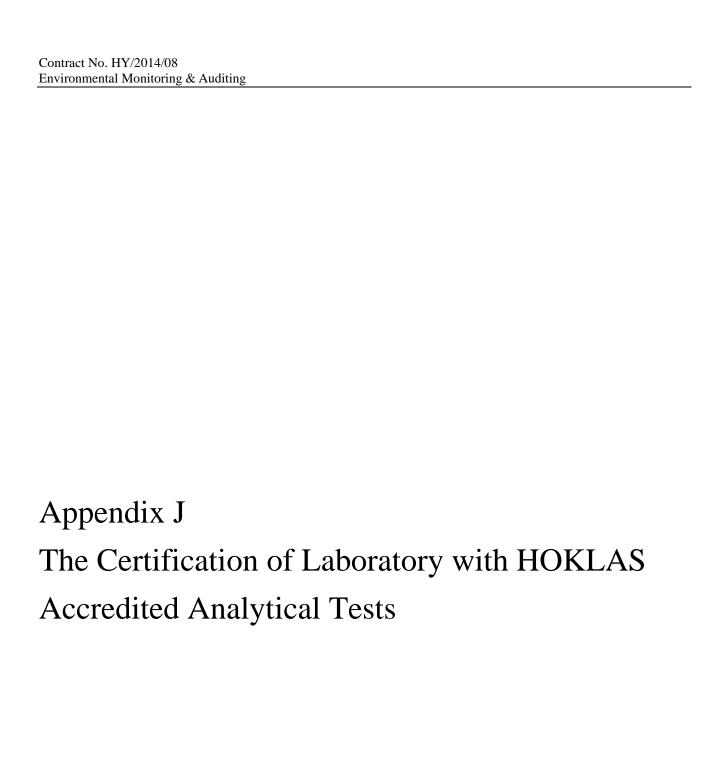



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation 認可證書

This is to certify that 特此證明

ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Flat/Rm D, 12/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong

香港九龍長沙灣永康街37-39號福源廣場12樓D室

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此项 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理關系 (見國際認可結婚・國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 15 November 2021

簽發日期:二零二一年十一月十五日

Registration Number : HOKLAS 241

Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

This certificate is issued subject to the terms and conditions laid down by HKAS 本體書級照香港認可盡訂立的條款及條件發出

L002316



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此間明

ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行載於認可範圍內下述測試類別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to isboratory operation (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date : 28 February 2020

签發日期:二零二零年二月二十八日

註冊號碼:

Registration Number : HOKLAS 066




Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日


This certificate is issued subject to the terms and conditions laid down by HKAS. 本證書按照香港認可處訂立的條款及條件發出

L001934

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

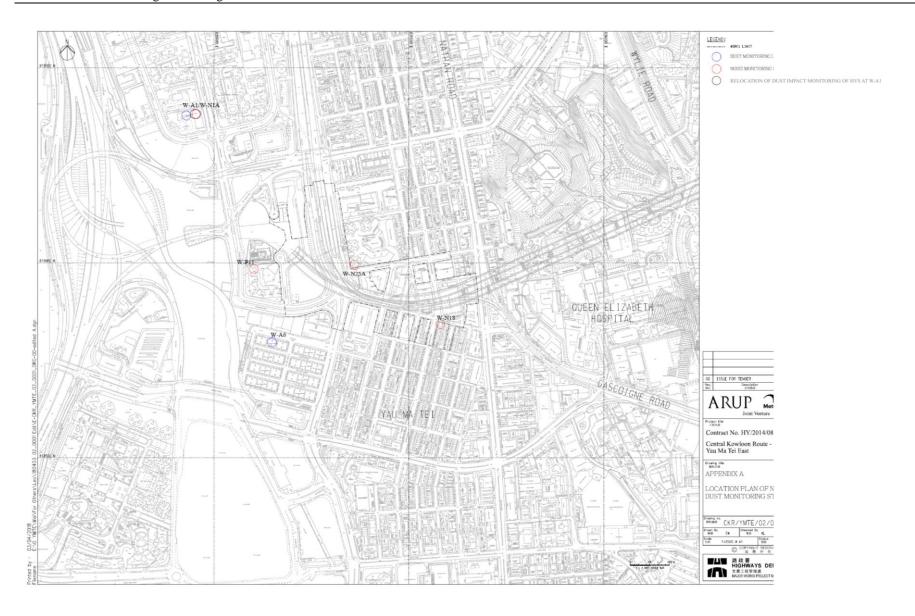

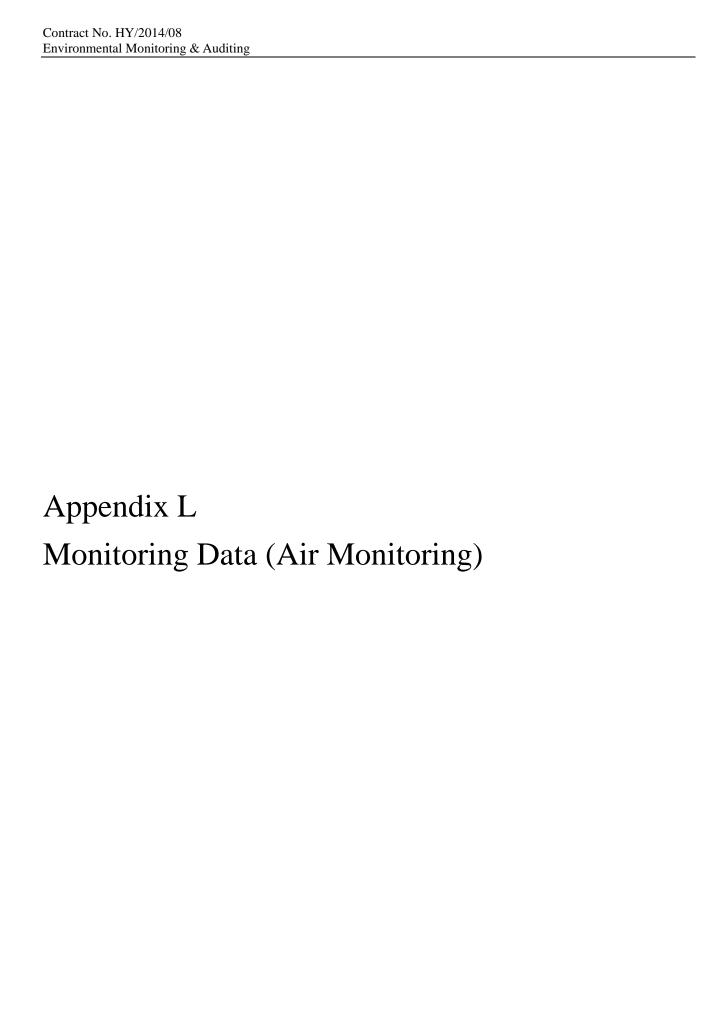

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 6, 12, 18, 23 and 29 September 2023

Parameter: TSP 1-hour Other Factors Nearby traffic

			1-hour TSP (μg/m ³)	
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)
06/09/2023	Fine	14:03	63	60	56
12/09/2023	Fine	14:10	62	68	54
18/09/2023	Fine	14:08	57	69	59
23/09/2023	Fine	14:13	65	55	56
29/09/2023	Fine	14:11	66	67	63
Mini	imum: 54 μg/m	3		Maximum: 69 μg	$/\mathrm{m}^3$

Location: Man Cheong Building (W-A6)
Monitoring date: 6, 12, 18, 23 and 29 September 2023

Parameter: TSP 1-hour Other Factors Nearby traffic

	1-hour TSP (μg/m³)										
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)						
06/09/2023	/2023 Fine 9:20 66 62										
12/09/2023	Fine	9:26	54	68	54						
18/09/2023	Fine	9:23	67	57	62						
23/09/2023	Fine	9:21	57	57	70						
29/09/2023	Fine	9:20	55	59	65						
Ì	Minimum: 54	μg/m ³		Maximum: 70 μg	g/m^3						

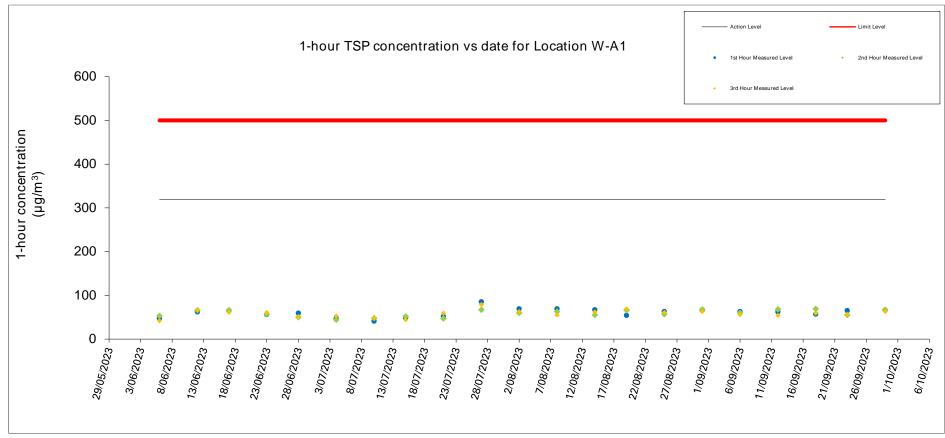


Figure 1: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A1

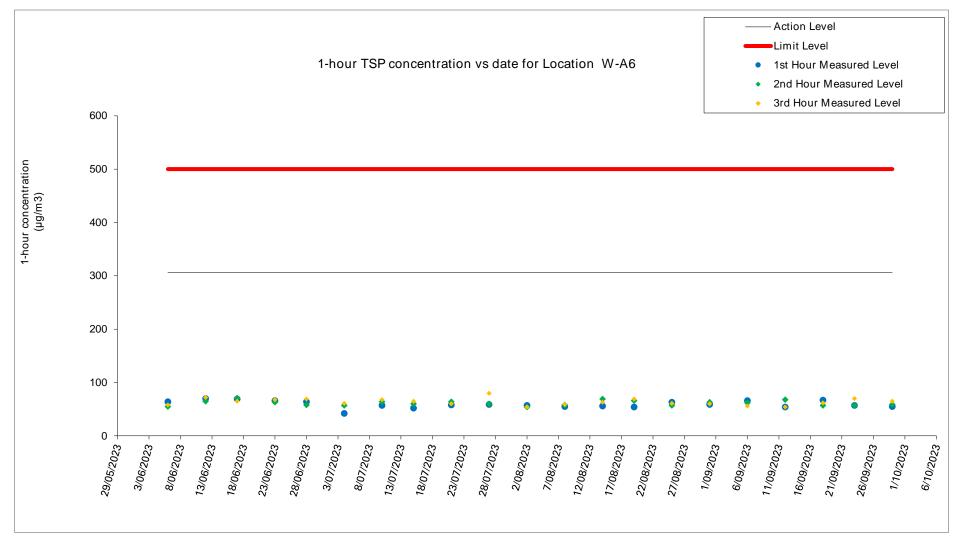


Figure 2: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A6

Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1) 6, 12, 18, 23 and 29 September 2023 Location:

Monitoring date:

TSP 24-hour Parameter: Other Factors Nearby traffic

Date of Calibration:	5-Sep-23	Slope =	43.6380
Calibration due date:	20-Sep-23	Intercept =	-7.9151
Date of Calibration:	22-Sep-23	Slope =	33.3686
Calibration due date:	7-Oct-23	Intercept =	-7.7799

											on due duter	, 000 20	•	meereepe	717733
Start Date	Weather Condition	Elapse Time Chart Reading				Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter W	Veight (g)	Particulate weight	Corr.		
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m ³)	Initial	Final	(g)	$(\mu g/m^3)$
6/09/2023	Fine	7570.5	7594.5	1440.0	46	46	46.0	28.6	1005.9	1.22	1759	2.7365	2.8576	0.1211	69
12/09/2023	Fine	7594.5	7618.5	1440.0	45	45	45.0	27.5	1006.6	1.20	1730	2.7416	2.7916	0.0500	29
18/09/2023	Fine	7618.5	7642.5	1440.0	45	46	45.5	29.4	1011.7	1.21	1749	2.7391	2.8051	0.0660	38
23/09/2023	Fine	7642.5	7666.5	1440.0	45	45	45.0	30.0	1010.2	1.57	2256	2.6813	2.7628	0.0815	36
29/09/2023	Fine	7666.5	7690.5	1440.0	45	45	45.0	29.9	1011.2	1.57	2258	2.7451	2.8074	0.0623	28
										Maximum:	69	μg/m ³	Minimum:	28	μg/m ³

Location:

Man Cheong Building (W-A6) 6, 12, 18, 23 and 29 September 2023 Monitoring date:

Parameter: TSP 24-hour Nearby traffic Other Factors

Date of Calibration:	5-Sep-23	Slope =	44.8219
Calibration due date:	20-Sep-23	Intercept =	-9.6608
Date of Calibration:	22-Sep-23	Slope =	25.6918
Calibration due date:	7-Oct-23	Intercept =	6.7069

Start Date	Weather Condition	Elapse Time			C	hart Reading		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter W	eight (g)	Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m ³)	Initial	Final	(g)	(μg/m ³)
6/09/2023	Fine	9886.6	9910.6	1440.00	42	42	42.0	28.6	1005.9	1.14	1642	2.7342	2.8408	0.1066	65
12/09/2023	Fine	9910.6	9934.6	1440.00	41	41	41.0	27.5	1006.6	1.12	1614	2.7336	2.7928	0.0592	37
18/09/2023	Fine	9934.6	9958.6	1440.00	41	41	41.0	29.4	1011.7	1.12	1616	2.7418	2.7851	0.0433	27
23/09/2023	Fine	9958.6	9982.6	1440.00	41	41	41.0	30.0	1010.2	1.32	1896	2.6750	2.7411	0.0661	35
29/09/2023	Fine	9982.6	10006.6	1440.00	42	42	42.0	29.9	1011.2	1.36	1954	2.7411	2.8196	0.0785	40
			-			-			-	Maximum:	65	μg/m ³	Minimum:	27	μg/m ³

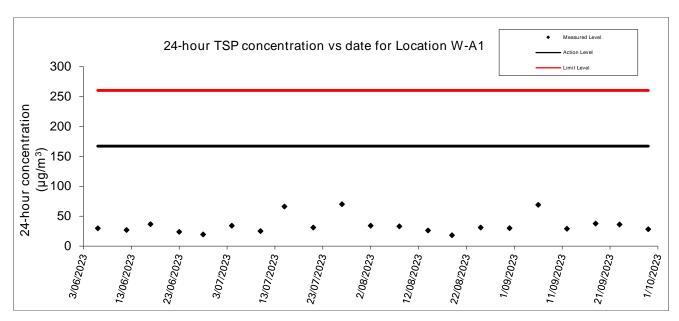


Figure 3: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at W-A1



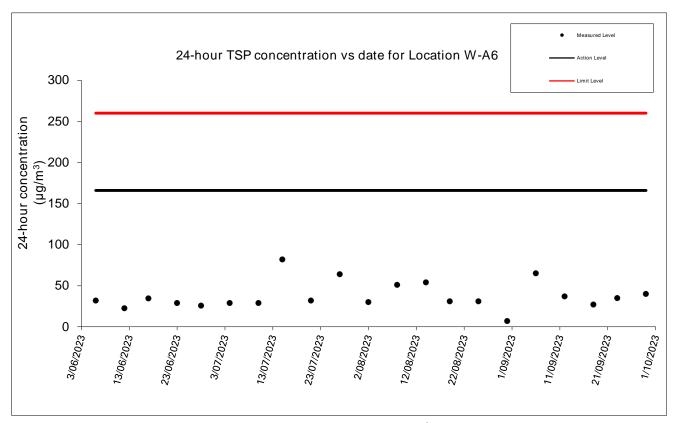



Figure 4: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at W-A6


Wind direction data for 6, 7, 12, 13, 18, 19, 23, 24, 29 and 30 September 2023




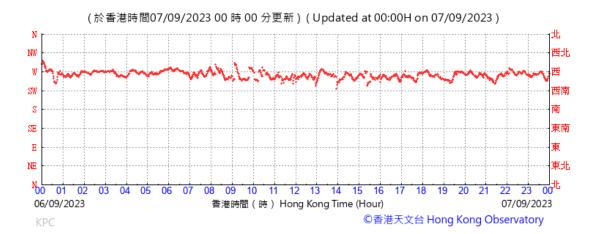


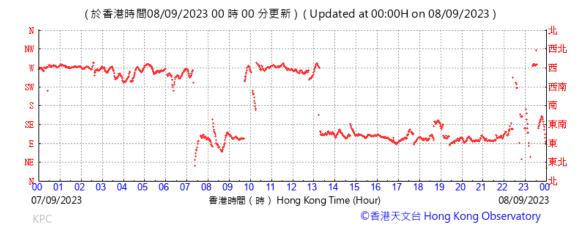

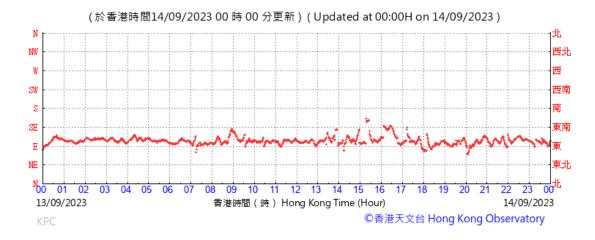


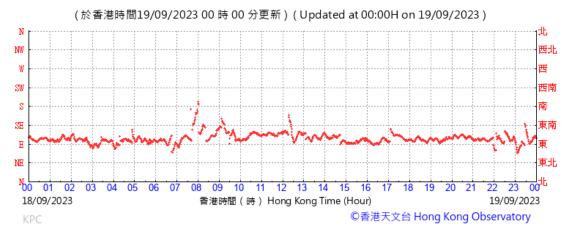


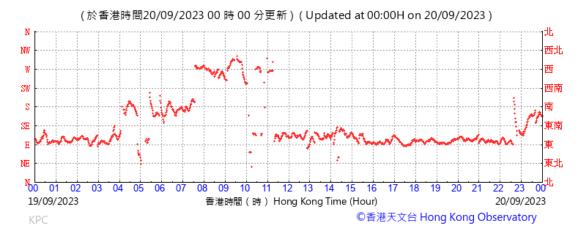

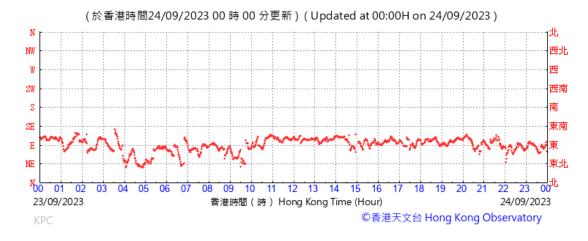



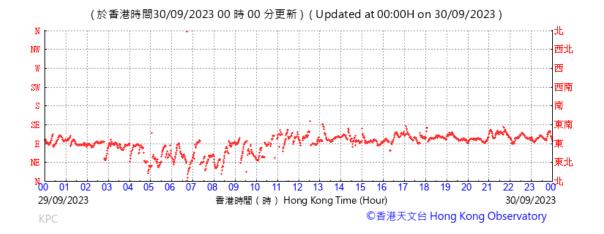


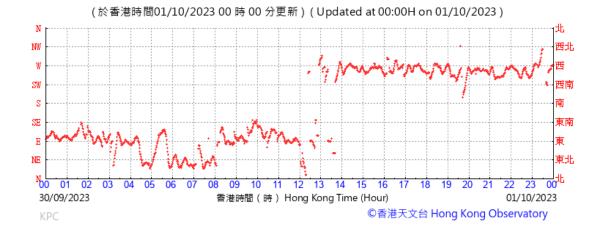



Wind speed data for 6, 7, 12, 13, 18, 19, 23, 24, 29 and 30 September 2023






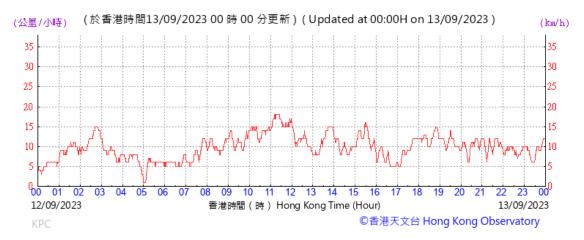

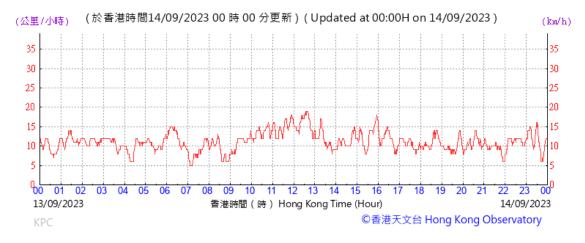


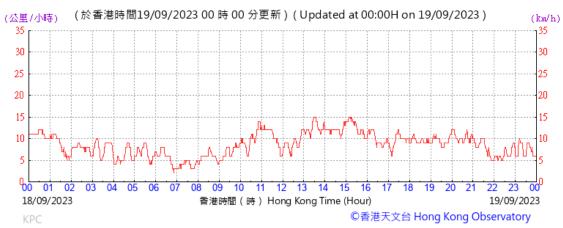



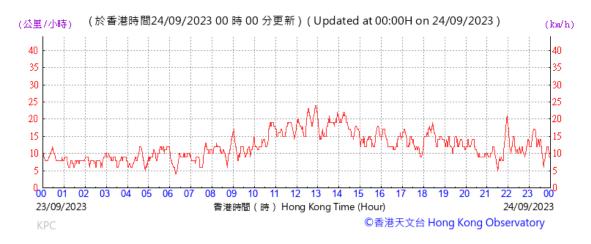



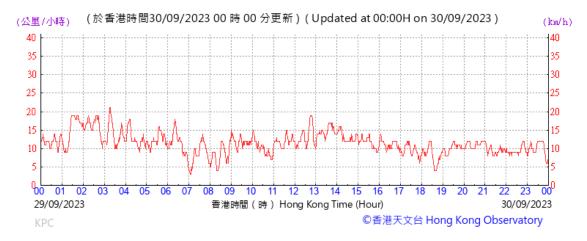



Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix M Monitoring Data (Noise) Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)

Monitoring date: 6, 12, 18, 23 and 29 September 2023

 $\begin{array}{ll} \text{Parameter:} & L_{\text{eq}},\,L_{10},\,L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$

Date	Weather	Start Time	-	End Time	L _{eq}	L_{10}	L ₉₀	Wind speed (m/s)
06/09/2023	Fine	14:05	-	14:35	64.8	72.7	55.5	3.1
12/09/2023	Fine	14:10	-	14:40	65.1	73.0	55.6	3.1
18/09/2023	Fine	14:08	-	14:38	65.3	72.8	56.0	3.6
23/09/2023	Fine	14:13	-	14:43	65.0	73.4	55.1	4.4
29/09/2023	Fine	14:10	-	14:40	66.2	72.7	56.8	3.6

Remark: 1. No examination was scheduled at Yau Ma Tei Catholic Primary School during the monitoring dates. The limit level of W-N1A would be 70 dB(A).

Location: Hydan Place (W-N18)

Monitoring date: 6, 12, 18, 23 and 29 September 2023

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, \ L_{90} \\ Other \ Factors & Nearby \ traffic \end{array}$

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	L_{10}	L ₉₀	Wind speed (m/s)
06/09/2023	Fine	9:51	-	10:21	69.7	74.9	64.8	3.1
12/09/2023	Fine	9:55	-	10:25	69.4	75.4	65.0	4.2
18/09/2023	Fine	9:54	-	10:24	68.9	75.1	63.7	1.9
23/09/2023	Fine	9:57	-	10:27	68.7	74.2	64.4	3.3
29/09/2023	Fine	9:53	-	10:23	69.9	75.6	65.0	3.6

Location: Prosperous Garden Block 1 (W-N25A)

Monitoring date: 6, 12, 18, 23 and 29 September 2023

 $\begin{array}{ll} \text{Parameter:} & L_{\text{eq}}, L_{10}, \ L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	L_{10}	L ₉₀	Wind speed (m/s)
06/09/2023	Fine	10:42	-	11:12	66.4	69.1	55.4	2.8
12/09/2023	Fine	10:45	-	11:15	66.8	69.4	55.2	3.6
18/09/2023	Fine	10:49	-	11:19	68.1	68.7	55.9	3.9
23/09/2023	Fine	10:47	-	11:17	66.3	69.0	55.1	4.7
29/09/2023	Fine	10:51	-	11:21	67.2	69.4	57.1	3.6

Location: The Coronation Tower 1 (W-P11)

Monitoring date: 6, 12, 18, 23 and 29 September 2023

 $\begin{array}{ll} Parameter: & L_{eq\text{,}}L_{10\text{,}}L_{90} \\ Other \ Factors & Nearby \ traffic \end{array}$

Date	Weather	Start Time	-	End Time	L _{eq}	L_{10}	L ₉₀	Wind speed (m/s)
06/09/2023	Fine	11:33	-	12:03	63.9	69.8	55.4	3.1
12/09/2023	Fine	11:37	-	12:07	68.3	70.4	65.5	4.7
18/09/2023	Fine	11:35	-	12:05	64.9	69.4	55.2	2.2
23/09/2023	Fine	11:40	-	12:10	68.9	71.0	65.3	4.4
29/09/2023	Fine	11:41	-	12:11	63.8	70.0	56.0	3.6

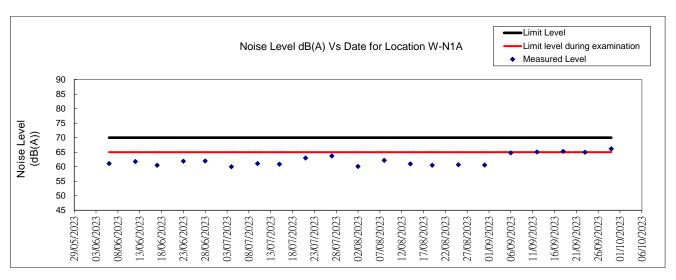


Figure 1: Graphical Illustration of Measured Noise Levels at W-N1A

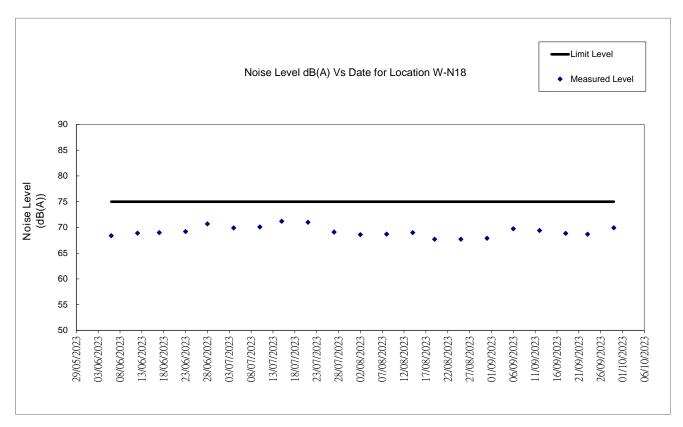


Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

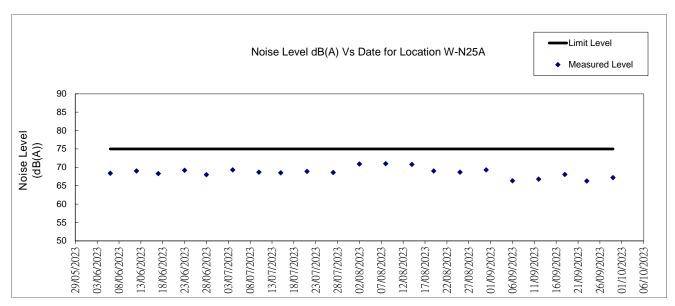


Figure 3: Graphical Illustration of Measured Noise Levels at W-N25A

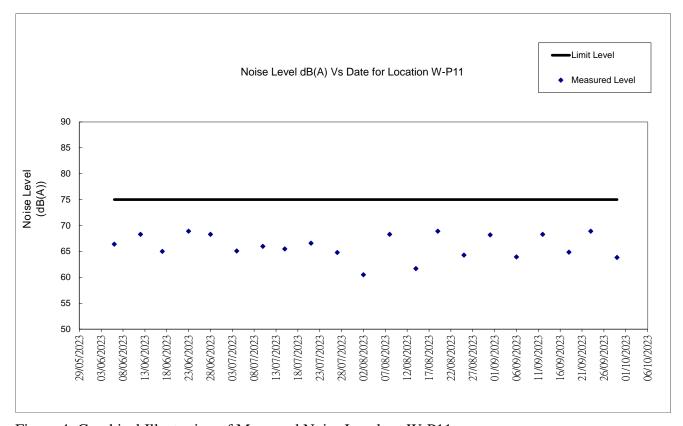


Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix N Waste Flow Table

Monthly Summary Waste Flow Table

Name of Department: Highways Department

Contract No. / Works Order No.: <u>HY/2014/08</u>

Monthly Summary Waste Flow Table for September 2023

[to be submitted not later than the 15th day of each month following reporting month] (All quantities shall be rounded off to 1 decimal place.)

	Ţ	<u> </u>	3 \ 1			
		Actı	ıal Quantities of <u>Ine</u>	ert Construction Wa	ste Generated Mon	thly
Month	(a)=(b)+(c)+(d)+(e)+ (f)+ (g)+ (h)+ (i)+ (j)+ (k) Total Quantity Generated	(b) Hard Rock and	(c) Reused in the	(d) Reused in other	(e) Disposed of as	(f) Imported Fill
	Total Qualitity delicrated	Large Broken	Contract	Projects	Public Fill	illiporteu Fili
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)
Jan-23	7222.40	1513.80	0.00	0.00	5651.20	0.00
Feb-23	9593.30	4670.50	0.00	3197.40	1643.90	0.00
Mar-23	18282.40	3615.20	0.00	4345.60	10200.20	0.00
Apr-23	17986.50	4884.60	214.00	6529.50	6302.60	0.00
May-23	24998.01	12599.30	174.70	0.00	12160.30	0.00
Jun-23	18607.21	8739.90	0.00	0.00	9813.90	0.00
Sub-total	96689.82	36023.30	388.70	14072.50	45772.10	0.00
Jul-23	19220.31	7881.60	244.90	2202.40	8755.90	0.00
Aug-23	17281.00	5068.80	462.80	0.00	11628.30	0.00
Sep-23						
Oct-23						
Nov-23						
Dec-23						
Total	154552.24	57610.70	1096.40	18799.10	76250.90	0.00
2018	51057.90	0.00	0.00	0.00	47715.60	2877.40
2019	112830.10	541.00	1523.80	13525.00	93132.90	3155.60
2020	193021.92	58778.00	1205.60	19108.60	112556.80	0.00
2021	104679.02	6461.30	1393.70	1144.70	92950.20	1542.90
2022	114787.22	3600.50	1804.50	18471.20	90202.70	0.00
Accumulated Total	730928.40	126991.50	7024.00	71048.60	512809.10	7575.90

	Actual Quantities of Non-inert Construction Waste Generated Monthly								
Month		g) tals	(h) Paper/ cardboard packaging		(i Plas			(j) al Waste	(k) Others, e.g. General Refuse disposed at Landfill
	(in '0	00kg)	(in '00	00kg)	(in '00)0kg)	(in '0	00kg)	(in 'tonnes)
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated
Jan-23	0.00	0.00	0.00	0.20	0.00	0.00	0.00	0.00	57.20
Feb-23	0.00	0.00	0.00	0.20	0.00	0.00	0.00	0.00	81.30
Mar-23	0.00	0.00	0.00	0.20	0.00	0.00	0.00	0.00	121.20
Apr-23	0.00	0.00	0.00	0.10	0.00	0.00	0.00	0.00	55.70
May-23	0.00	0.00	0.00	0.00	0.00	0.01	0.00	0.00	63.70
Jun-23	0.00	0.00	0.00	0.50	0.00	0.01	0.00	0.00	52.90
Sub-total	0.00	0.00	0.00	1.20	0.00	0.02	0.00	0.00	432.00
Jul-23	0.00	31.30	0.00	0.20	0.00	0.01	0.00	0.00	73.80
Aug-23	0.00	20.20	0.00	0.60	0.00	0.01	0.00	0.00	114.70
Sep-23	0.00	6.50	0.00	0.00	0.00	0.00	0.00	0.00	114.60
Oct-23									
Nov-23									
Dec-23									
Total	0.00	58.00	0.00	2.00	0.00	0.04	0.00	0.00	735.10
2018	28.40	0.00	0.00	0.00	0.00	0.00	2.00	0.00	434.50
2019	0.00	9.10	3.40	6.80	0.00	0.00	5.20	0.00	927.30
2020	69.20	0.00	3.30	0.00	0.02	0.00	25.30	0.00	1275.10
2021	30.20	0.00	4.80	0.00	0.02	0.00	25.50	0.00	1125.70
2022	108.60	0.00	3.30	0.40	0.02	0.00	1.20	0.00	594.80
Accumulated Total	236.40	67.10	14.80	9.20	0.06	0.04	59.20	0.00	5092.50

Remark: Construction waste records for August 2023 had been updated.



Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

Statistical Summary of Exceedances

	Air Quality							
Reporting Period	Action Level	Limit Level						
1 – 30 September 2023	0	0						
	Noise							
Reporting Period	Action Level	Limit Level						
1 – 30 September 2023	2	0						

Statistical Summary of Environmental Complaints

Donarting Daried	Environmental Complaint Statistics					
Reporting Period	Frequency	Cumulative	Complaint Nature			
1 – 30 September 2023	4	99	Noise nuisance, air quality, water quality			

Statistical Summary of Environmental Non-compliance


Donauting Davied	Environmental Non-compliance Statistics						
Reporting Period Frequency		Cumulative	Details				
1 – 30 September 2023	0	2	N/A				

Statistical Summary of Environmental Summons


Donarting Daried	Environmental Summons Statistics						
Reporting Period	Frequency	Cumulative	Details				
1 – 30 September 2023	0	1	N/A				

Statistical Summary of Environmental Prosecution

D 4: D : 1	Environmental Prosecution Statistics			
Reporting Period	Frequency	Details		
1 – 30 September 2023	0	0	N/A	

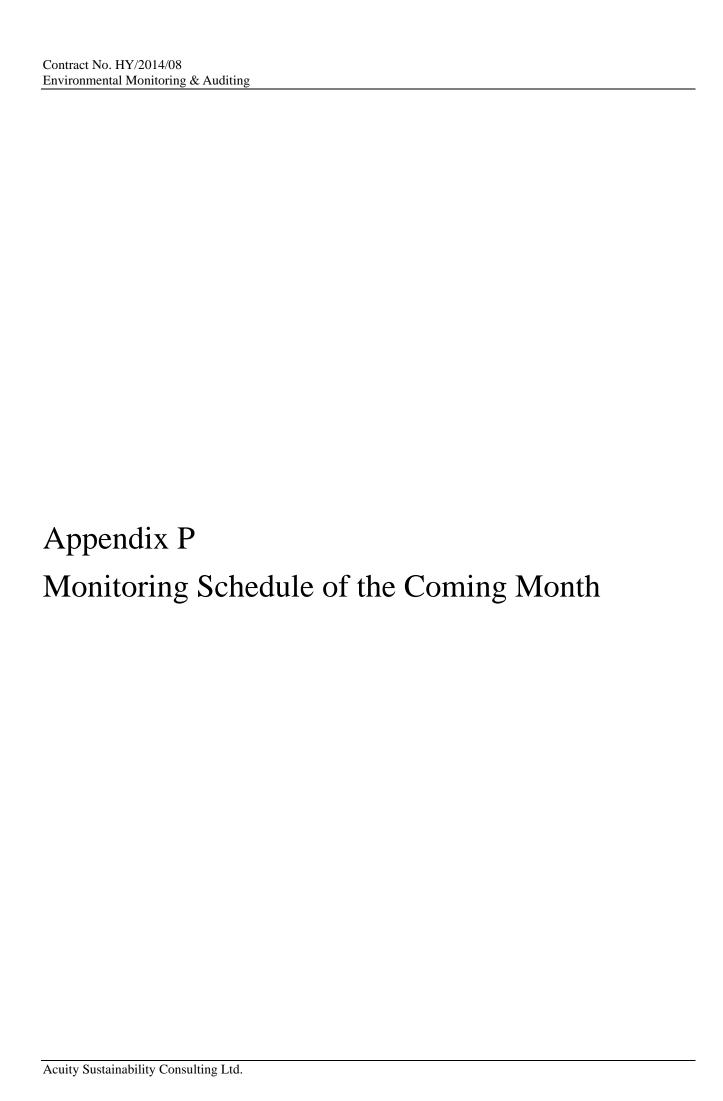


	Impact Monitoring Schedule for YMTE					
			Oct-23			
Sun	Mon	Tue	Wed	Thu	Fri	Sat
1	2	3	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	5	6	7
8	9	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A				14
15	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	17	18	19	20	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A
22	23	24	25	26	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	28
29	30	31				

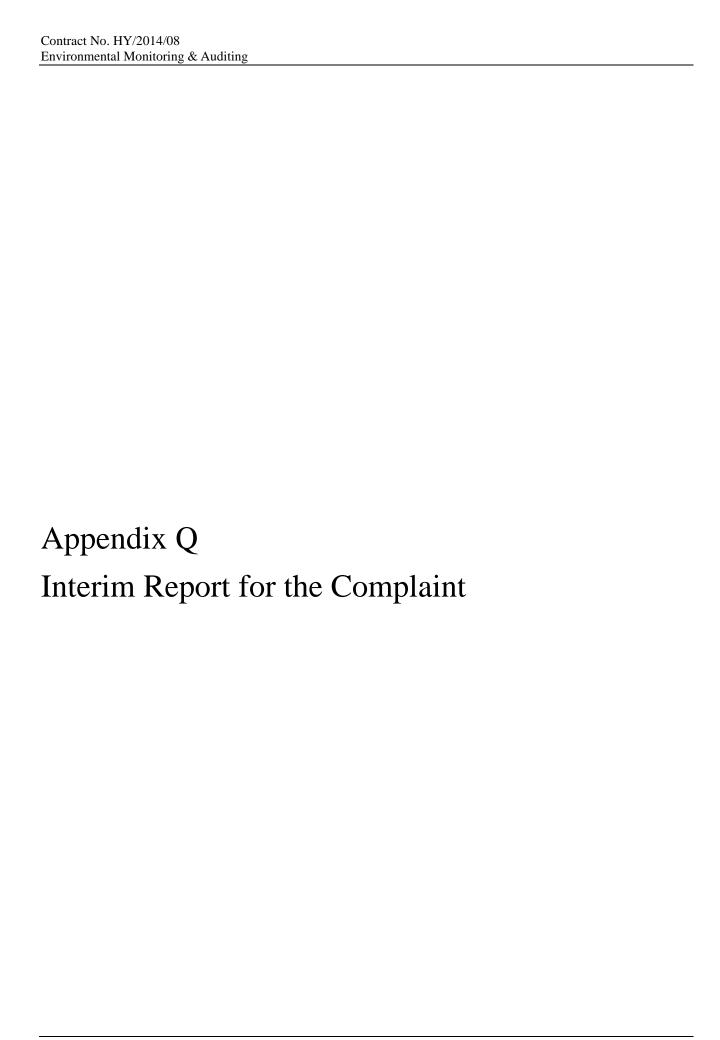

Complaint Code EC096-CKRYMTE20230914_001 Complaint description The complaint was received on 14 Sep 2023, about the air nuisance of unpleasant smell near the site area at Zone G. Parameter Air quality Investigation finding The complainant is middle-level resident of Tak Cheong Building. The complaint was concerned about the air nuisance of unpleasant smell near the site area Zone G¹. The investigation period would be from 8 Sep 2023 to 14 Sep 2023. For construction works undertaken during permitted or restricted hours, all equipment operated on site was under regular maintenance. No malfunction of equipment, no open burning nor black smoke emission was observed and recorded as confirmed by the Contractor. The odor was suspected to be the exhaust of a generator which was operated at nighttime from 1900 to 0700, from 8 Sep 2023 to 14 Sep 2023, under the valid Construction Noise Permits (CNP) (Permit No: GW-RE0590-23). According to the Contractor information, the generator uses ultra-low Sulphur diesel and is checked monthly. Filter of the generator will be replaced if necessary. Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual and CNP, it is concluded that there was no non-compliance of the Project regarding air quality impact from the construction site. Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: • Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell near taken: • Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell near the site area Zone G¹. Witigation measure of diverting the outlet exhaust Verified by ET. (Acuty Sustainability Consulting Limited) Date 18 September 2023	Project	Control Voyaloon	Pouta Vou Ma Tai	Fast Saction	
The complaint was received on 14 Sep 2023, about the air nuisance of unpleasant smell near the site area at Zone G.		Central Kowloon Route, Yau Ma Tei East Section			
Parameter	*				
Parameter Air quality The complainant is middle-level resident of Tak Cheong Building. The complaint was concerned about the air nuisance of unpleasant smell near the site area Zone G¹. The investigation period would be from 8 Sep 2023 to 14 Sep 2023. For construction works undertaken during permitted or restricted hours, all equipment operated on site was under regular maintenance. No malfunction of equipment, no open burning nor black smoke emission was observed and recorded as confirmed by the Contractor. The odor was suspected to be the exhaust of a generator which was operated at nighttime from 1900 to 0700, from 8 Sep 2023 to 14 Sep 2023, under the valid Construction Noise Permits (CNP) (Permit No: GW-RE0590-23). According to the Contractor information, the generator uses ultra-low Sulphur diesel and is checked monthly. Filter of the generator will be replaced if necessary. Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual and CNP, it is concluded that there was no non-compliance of the Project regarding air quality impact from the construction site. Actions taken / to be taken	Complaint description				
The complainant is middle-level resident of Tak Cheong Building. The complaint was concerned about the air nuisance of unpleasant smell near the site area Zone G¹. The investigation period would be from 8 Sep 2023 to 14 Sep 2023. For construction works undertaken during permitted or restricted hours, all equipment operated on site was under regular maintenance. No malfunction of equipment, no open burning nor black smoke emission was observed and recorded as confirmed by the Contractor. The odor was suspected to be the exhaust of a generator which was operated at nighttime from 1900 to 0700, from 8 Sep 2023 to 14 Sep 2023, under the valid Construction Noise Permits (CNP) (Permit No: GW-RE0590-23). According to the Contractor information, the generator uses ultra-low Sulphur diesel and is checked monthly. Filter of the generator will be replaced if necessary. Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual and CNP, it is concluded that there was no non-compliance of the Project regarding air quality impact from the construction site. Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and Divert the outlet exhaust to the opposition direction of Tak Cheong Building². Works location of the concerned area Mitigation measure of diverting the outlet exhaust Kako Ho Reviewed by ETL (Acuity Sustainability Consulting Limited) Reviewed by ETL (ERM-Hong Kong, Limited) Works location of the concerned area Manual and Consulting Limited Manual To M	Doromotor				
concerned about the air nuisance of unpleasant smell near the site area Zone G¹. The investigation period would be from 8 Sep 2023 to 14 Sep 2023. For construction works undertaken during permitted or restricted hours, all equipment operated on site was under regular maintenance. No malfunction of equipment, no open burning nor black smoke emission was observed and recorded as confirmed by the Contractor. The odor was suspected to be the exhaust of a generator which was operated at nighttime from 1900 to 0700, from 8 Sep 2023 to 14 Sep 2023, under the valid Construction Noise Permits (CNP) (Permit No: GW-RE0590-23). According to the Contractor information, the generator uses ultra-low Sulphur diesel and is checked monthly. Filter of the generator will be replaced if necessary. Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual and CNP, it is concluded that there was no non-compliance of the Project regarding air quality impact from the construction site. Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and Divert the outlet exhaust to the opposition direction of Tak Cheong Building². Remarks (Shown in next page) Prepared by ET (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Reviewed by ETL (Kako Ho Werified by IEC (ERM-Hong Kong, Limited) Werified by IEC (ERM-Hong Kong, Limited)					
operated on site was under regular maintenance. No malfunction of equipment, no open burning nor black smoke emission was observed and recorded as confirmed by the Contractor. The odor was suspected to be the exhaust of a generator which was operated at nighttime from 1900 to 0700, from 8 Sep 2023 to 14 Sep 2023, under the valid Construction Noise Permits (CNP) (Permit No: GW-RE0590-23). According to the Contractor information, the generator uses ultra-low Sulphur diesel and is checked monthly. Filter of the generator will be replaced if necessary. Considering the fulfillment of stipulated requirements by the Contractor for EM&A manual and CNP, it is concluded that there was no non-compliance of the Project regarding air quality impact from the construction site. Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: • Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and • Divert the outlet exhaust to the opposition direction of Tak Cheong Building ² . Remarks (Shown in next page) Reviewed by ETL (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mand	investigation finding	concerned about the air nuisance of unpleasant smell near the site area Zone G1. The			
manual and CNP, it is concluded that there was no non-compliance of the Project regarding air quality impact from the construction site. Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and Divert the outlet exhaust to the opposition direction of Tak Cheong Building ² . Remarks (Shown in next page) Prepared by ET (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To		operated on site was under regular maintenance. No malfunction of equipment, no open burning nor black smoke emission was observed and recorded as confirmed by the Contractor. The odor was suspected to be the exhaust of a generator which was operated at nighttime from 1900 to 0700, from 8 Sep 2023 to 14 Sep 2023, under the valid Construction Noise Permits (CNP) (Permit No: GW-RE0590-23). According to the Contractor information, the generator uses ultra-low Sulphur diesel and is checked monthly. Filter of the generator will be replaced if necessary.			
regarding air quality impact from the construction site. Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: • Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and • Divert the outlet exhaust to the opposition direction of Tak Cheong Building ² . Remarks (Shown in next page) 1. Works location of the concerned area 2. Mitigation measure of diverting the outlet exhaust Reviewed by ETL (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To Mandy To Mandy To The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures are taken: e Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and e Divert the outlet exhaust to the opposition direction of Tak Cheong Building ² . Remarks (Shown in next page) 1. Works location of the concerned area 2. Mitigation measure of diverting the outlet exhaust Kako Ho Reviewed by ETL (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Werified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To					
Actions taken / to be taken The Contractor had followed EM&A Manual and CNP strictly to implement mitigation measures in order to minimize air quality impact to the public. In view of public concerns, the following additional remedial measures are taken: Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and Divert the outlet exhaust to the opposition direction of Tak Cheong Building ² . Remarks (Shown in next page) Prepared by ET (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To Mandy To					
Carry out site inspection to ensure all PMEs are well-maintained and in proper function to avoid potential generation of unpleasant smell; and Divert the outlet exhaust to the opposition direction of Tak Cheong Building ² . Remarks (Shown in next page) 1. Works location of the concerned area 2. Mitigation measure of diverting the outlet exhaust Prepared by ET (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To Mandy To Mandy To Mandy To	Actions taken / to be taken	The Contractor had followed EM&A Manual and CNP strictly to implement mitigation			
Remarks (Shown in next page) 1. Works location of the concerned area 2. Mitigation measure of diverting the outlet exhaust Prepared by ET (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To		 Carry out site inspection to ensure all PMEs are well-maintained and if function to avoid potential generation of unpleasant smell; and 			
Prepared by ET (Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To	Remarks				
(Acuity Sustainability Consulting Limited) Reviewed by ETL (Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Mandy To	(Shown in next page)	2. Mitigation	measure of diverti	ng the outlet exhaust	
(Acuity Sustainability Consulting Limited) Verified by IEC (ERM-Hong Kong, Limited) Mandy To Muly Consulting Limited	(Acuity Sustainability	Kako Ho	Ho		
Limited)	(Acuity Sustainability	Kevin Li	K		
Date 18 September 2023	(ERM-Hong Kong,	Mandy To	Mandy2.		
	Date	18 Septem	nber 2023		

Remark 1: Works location of the concerned area

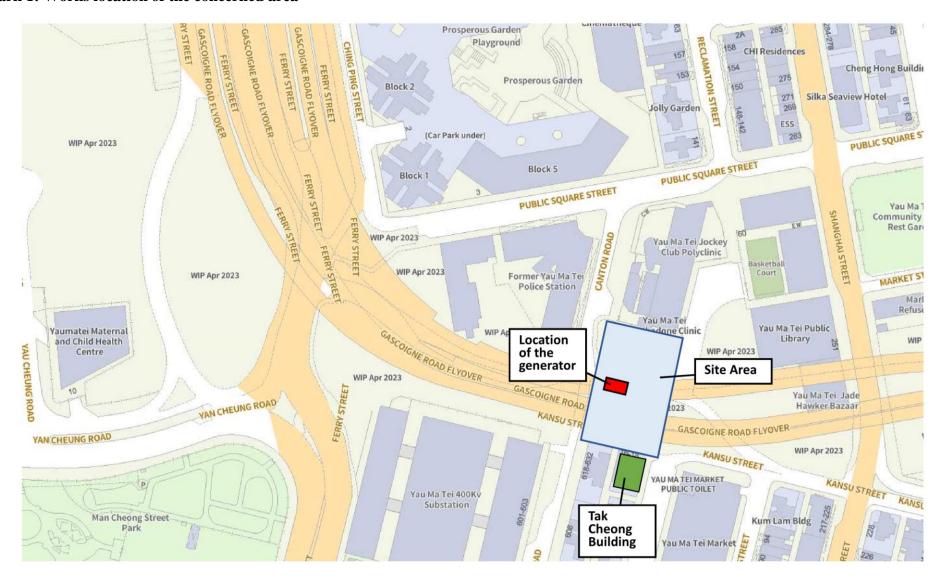


Remark 2: Mitigation measure of diverting the outlet exhaust



Project	Central Kowloon Route, Yau Ma Tei East Section			
Complaint Code	EC097-CKRYMTE20230920_001			
Complaint description	The complainant made the complaint on 15 Sep 2023, about the heavy vehicle leaving			
		site without washin	g the wheels.	
Parameter	Water Quality			
Investigation finding	The complaint was concerned about the heavy vehicle leaving the construction site ¹ without washing the wheels.			
	According to the Contractor's information, notice has been displayed to remind workers to wash the vehicles before leaving the site ² . Wheel washing has been performed regularly for vehicle before leaving the site ³ .			
	The Contractor was advised to perform checking and remind workers to ensure all			
Actions taken / to be taken	vehicles leaving the site are properly washed.			
Actions taken / to be taken	The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize nuisance to the public. The Contractor was advised to perform checking to ensure all vehicles leaving the site are			
	washed.			
Remarks (Shown in next page)	 Works location of the concerned area Wheel washing notice Wheel washing 			
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho		
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K		
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy2.		
Date	26 Septem	nber 2023		

Remark 1: Works location of the concerned area

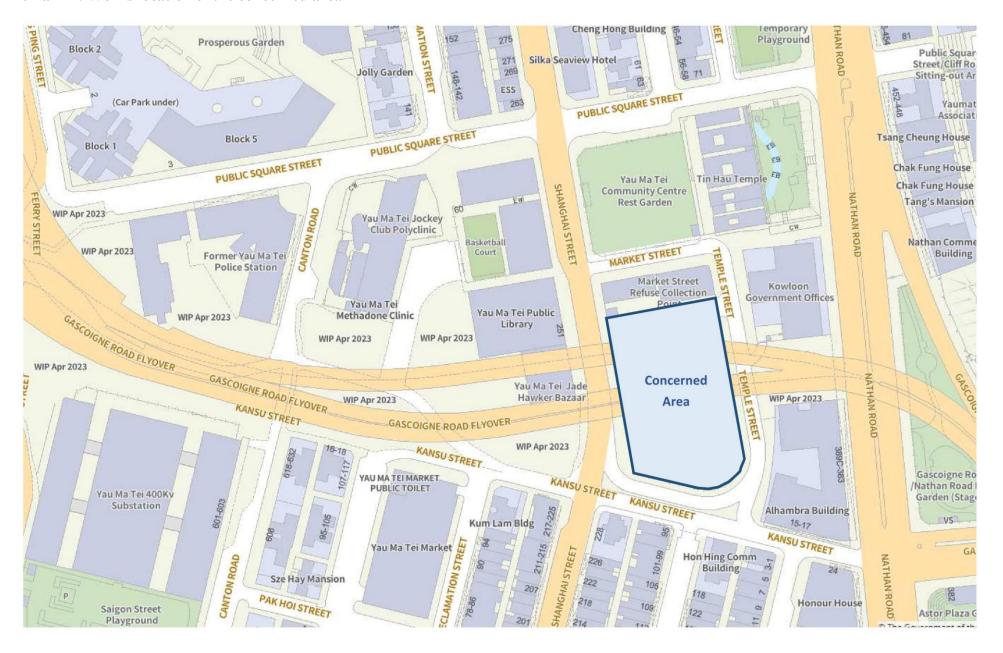

Remark 2: Wheel washing notice




Remark 3: Wheel washing



Project	Central Kowloon I	Route, Yan Ma Tei	East Section	
Complaint Code	Central Kowloon Route, Yau Ma Tei East Section EC098-CKRYMTE20230920_002			
Complaint description	The complainant made the complaint on 11 Sep 2023, about the construction noise			
	from the site area during nighttime.			
Parameter	Construction Noise			
Investigation finding	The complaint was concerned about the construction noise from the site area during nighttime. The investigation period would be from 05 Sep 2023 to 11 Sep 2023.			
	For construction works undertaken within restricted hours, the Contractor applied for valid Construction Noise Permits (CNP) (Permit No: GW-RE1021-23) which was granted from EPD, effective from 19 Aug 2023 to 18 Nov 2023 with coverage of the construction site at the concerned area ¹ . As noted by the contractor, launching of formtraveller at Shanghai Street was carried out from 1900 5 Sep 2023 to 0700 6 Sep 2023. PME used during launching of formtraveller included 2 hydraulic jack and 1 hydraulic pump. The aforementioned PME were classified in PME Group B of CNP and were allowed to be operated in Working Zone during 0000-0700 and 1900-2400 on any day not being a general holiday. As confirmed by the Contractor, CNP conditions had been strictly followed when operated PME during restricted hours. No violation and non-compliance of CNP was observed or recorded. The Contractor had followed the requirements as stipulated in CNP.			
	Considering the fulfillment of stipulated requirements by the Contractor for CNP, it is concluded that there was no non-compliance of the Project regarding noise quality impact from construction site.			
Actions taken / to be taken	The Contractor had followed granted CNP strictly to implement mitigation measures in order to minimize nuisance to the public.			
	 In view of public concerns, the following additional remedial measures are taken: Provide training to workers to minimize noise; Reschedule the operation time of the noisy equipment to less sensitive hours; Provide site supervision to ensure the noise mitigation measures required in the CNP are maintained properly to alleviate noise impacts; and Review the working hours and method to reduce noise nuisance to Noise Sensitive Receivers (NSRs) during event and night-time. 			
Remarks (Shown in next page)	1. Works loc	ation of the concern	ned area	
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho		
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K		
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy2.		
Date	26 Septem	ber 2023		

Remark 1: Works location of the concerned area

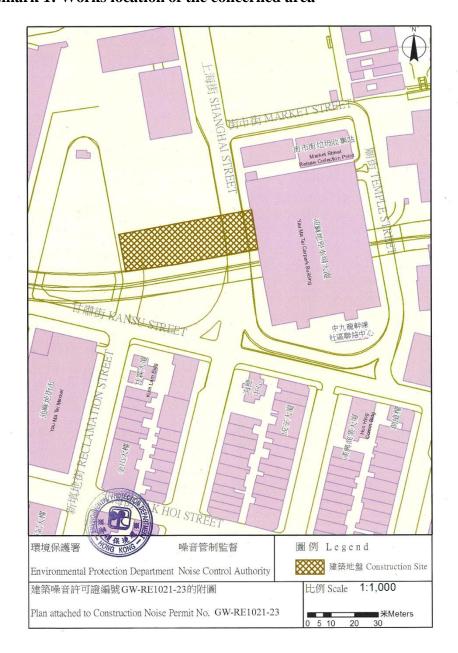

Project	Central Kowloon I	Route, Yau Ma Tei	Fast Section	
Complaint Code	EC099-CKRYMT		Last Section	
Complaint description	The complainant made the complaint on 28 Sep 2023, about the construction noise			
r a same r	from the site area at around 0000 and 0504 on 28 Sep 2023.			
Parameter	Construction Noise			
Investigation finding	The complaint was concerned about the construction noise from the site area at around 0000 and 0504 on 28 Sep 2023.			
	valid Construction from EPD, effective site at the concern carried out from 0 Sep 2023. PME use with crane (5.5 too label showing sour in PME Group Gr	Noise Permits (CN) we from 23 Aug 202 ed area ¹ . As noted 100 to 0600 and noted for installation of the composition of the co		
	Considering the fulfillment of stipulated requirements by the Contractor for CN concluded that there was no non-compliance of the Project regarding noise quality from construction site.			
Actions taken / to be taken				
	 In view of public concerns, the following additional remedial measures are taken: Provide training to workers to minimize noise; Reschedule the operation time of the noisy equipment to less sensitive hours; Provide site supervision to ensure the noise mitigation measures required in the CNP are maintained properly to alleviate noise impacts; and Review the working hours and method to reduce noise nuisance to Noise Sensitive Receivers (NSRs) during event and night-time. 			
Remarks (Shown in next page)	1. Works loc	ation of the concern	ned area	
Prepared by ET (Acuity Sustainability Consulting Limited)	Kako Ho	Ho		
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K		
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy2.		
Date	04 Octobe	r 2023		

Remark 1: Works location of the concerned area

