

Environmental Protection Department

Contract No. HY/2012/06

Widening of Fanling Highway - Tai Hang to Wo Hop Shek Interchange

Monthly EM&A Report For September 2019

[10/2019]

Name	Signature
Alex Chan	Alec
Y W Fung	4
	Alex Chan

	- W-W-W		8.50	
Version:	Rev. 0	Date:	11 October 2019	

Disclaimer

This report is prepared for Environmental Protection Department and is given for its sole benefit in relation to and pursuant to Contract No. HY/2012/06 and may not be disclosed to, quoted to or relied upon by any person other than Environmental Protection Department without our prior written consent. No person (other than Environmental Protection Department) into whose possession a copy of this report comes may rely on this report without our express written consent and Environmental Protection Department may not rely on it for any purpose other than as described above.

AECOM Asia Co. Ltd.

15/F, Grand Central Plaza, Tower 1, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong Tel: (852) 3922 9000 Fax: (852) 2317 7609 www.aecom.com



Hyder-Arup-Black & Veatch Joint Venture c/o Arcadis 17/F, Two Harbour Square, 180 Wai Yip Street, Kwun Tong, Hong Kong Attn: Mr. James Penny

Your Reference

Our Reference AFK/EC/ST/cy/T329380/2 2.05/L-0284

3/F International Trade Tower 348 Kwun Tong Road Kowloon Hong Kong

T +852 2828 5757 F +852 2827 1823 mottmac.hk Environmental Monitoring and Audit (EM&A) for Widening of Tolo Highway/Fanling Highway between Island House Interchange and Fanling Stage 2 (between Tai Hang to Wo Hop Shek Interchange) Environmental Permit No. EP-324/2008/E Condition 3.3 – Submission of Monthly EM&A Report – September 2019 for the portion of Stage 2 works under Contract No. HY/2012/06

10 October 2019 By Fax (2805 5028) & Hand

We refer to the Monthly EM&A Report – September 2019 received on 8 October 2019 submitted by the Environmental Team via email. Pursuant to Environmental Permit Condition 3.3, I hereby verify the Monthly EM&A Report – September 2019 (Rev. 0) for the portion of works under Stage 2 of the captioned Project which is managed under Contract No. HY/2012/06.

Yours faithfully for MOTT MACDONALD HONG KONG LIMITED



Steven Tang Independent Environmental Checker

c.c.

HyD AECOM Mr. Ricky Yeung Mr. YW Fung By Fax (2714 5198) By Fax (3922 9797)

TABLE OF CONTENTS

			Page
EX	CUTI	VE SUMMARY	3
1	INTF	RODUCTION	5
		Background Scope of Report Project Organization Summary of Construction Works Summary of EM&A Programme Requirements	5 6 6 7 7
2	AIR	QUALITY MONITORING	8
	2.1 2.2 2.3 2.4 2.5 2.6 2.7	Monitoring Requirements Monitoring Equipment Monitoring Locations Monitoring Parameters and Frequency Monitoring Methodology Monitoring Schedule for the Reporting period Results and Observations	8 8 8 9 10 11
3	NOIS	SE MONITORING	12
	3.1 3.2 3.3 3.4 3.5 3.6 3.7	Monitoring Requirements Monitoring Equipment Monitoring Locations Monitoring Parameters and Frequency Monitoring Methodology Monitoring Schedule for the Reporting period Monitoring Results	12 12 12 12 13 13
4	ENV	IRONMENTAL SITE INSPECTION AND AUDIT	15
	4.1 4.2 4.3 4.4 4.5 4.6	Site Inspection Advice on the Solid and Liquid Waste Management Status Environmental Licenses and Permits Implementation Status of Environmental Mitigation Measures Summary of Exceedances of the Environmental Quality Performance Limit Summary of Complaints, Notification of Summons and Successful Prosecutions	15 17 17 19 20 20
5	FUT	URE KEY ISSUES	21
	5.1 5.2 5.3	Construction Programme for the Coming Months Key Issues for the Coming Month Monitoring Schedule for the Coming Month	21 21 21
6	CON	ICLUSIONS AND RECOMMENDATIONS	22
	6.1 6.2	Conclusions Recommendations	22 22

List of Tables

Table 1.1	Contact Information of Key Personnel
Table 2.1	Air Quality Monitoring Equipment
Table 2.2	Locations of Impact Air Quality Monitoring Station
Table 2.3	Air Quality Monitoring Parameters and Frequency
Table 2.4	Summary of 1-hour TSP Monitoring Results in the Reporting Period
Table 2.5	Summary of 24-hour TSP Monitoring Results in the Reporting Period
Table 3.1	Noise Monitoring Equipment
Table 3.2	Locations of Impact Noise Monitoring Stations
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 3.4	Summary of Construction Noise Monitoring Results in the Reporting Period
Table 4.1	Summary of Waste Flow Table for Contract No. HY/2012/06
Table 4.2	Summary of Environmental Licensing and Permit Status

Figures

Figure 1.1	General Project Layout Plan of Contract No. HY/2012/06
Figure 1.2	General Project Layout Plan of Contract No. 02/HY/2015 (Works Order Nos. CB128520-5
	and CB128519-0)
Figure 1.3a-b	Locations of Monitoring Station
Figure 4.1	Environmental Complaint Handling Procedures

List of Appendices

Appendix A	Project Organization Structure
Appendix B	Construction Programme
Appendix C	Implementation Schedule of Environmental Mitigation Measures (EMIS)
Appendix D	Summary of Action and Limit Levels
Appendix E	Calibration Certificates of Monitoring Equipments
Appendix F	EM&A Monitoring Schedules
Appendix G	Impact Air Quality Monitoring Results and their Graphical Presentation
Appendix H	Meteorological Data for the Reporting period
Appendix I	Impact Daytime Construction Noise Monitoring Results and their Graphical Presentation
Appendix J	Event Action Plan
Appendix K	Site Inspection Summaries
Appendix L	Statistics on Complaints, Notifications of Summons and Successful Prosecutions
Appendix M	Complaint Investigation Report

EXECUTIVE SUMMARY

The proposed widening of Tolo Highway and Fanling Highway between Island House Interchange and Fanling (the Project) is a Designated Project under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO). An Environmental Impact Assessment (EIA) Report (the approved EIA Report) together with an Environmental Monitoring and Audit (EM&A) Manual (the approved EM&A Manual) were completed and approved under the EIAO on 14 July 2000 (Register Number: EIA-043/2000).

The objective of the Project "Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling" is to widen Tolo Highway and Fanling Highway to dual 4-lane carriageway in order to alleviate the current traffic congestion problems and to cope with the increasing transport demands to and from the urban areas and also cross boundary traffic.

The Project is a designated project and governed by an Environmental Permit (EP-324/2008) issued by the EPD on 23 December 2008. Subsequently, the EPD issued Variation of Environmental Permits of EP-324/2008/A, EP-324/2008/B, EP-324/2008/C and EP-324/2008/D on 31 January 2012, 17 March 2014, 27 March 2015 and 27 August 2015 respectively. The current valid VEP was applied on 29 December 2016 and the VEP (EP-324/2008/E) was subsequently granted on 26 January 2017.

The construction works for this Project are delivered in 2 stages i.e. Stage 1 (between Island House Interchange and Tai Hang) and Stage 2 (between Tai Hang and Wo Hop Shek Interchange). Stage 2 would be implemented under three works contracts. Contract No. HY/2012/06 "Widening of Fanling Highway – Tai Hang to Wo Hop Shek Interchange" and the entrusted portion to CEDD under Contract No. CV/2012/09 "Liantang/Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works – Contract 3". In addition, Contract No. "Provision of Bus-Bus Interchange on Fanling Highway Kowloon Bound" was carried out within the site boundary of Contract No. 02/HY/2015. This report focuses on Contract No. HY/2012/06 "Widening of Fanling Highway – Tai Hang to Wo Hop Shek Interchange" in Stage 2 of the Project and "Provision of Bus-Bus Interchange on Fanling Highway Kowloon Bound" under Works Order Nos. CB128520-5 and CB128519-0 in Contract No. 02/HY/2015 "Highway Department Term Contract (Management and Maintenance of Roads in Tai Po and North District excluding High Speed Roads 2016-2022)". The construction works of Works Order Nos. CB128520-5 and CB128519-0 under Contract No. 02/HY/2015 have been completed on 23 May 2018.

Pursuant to the EP (EP-324/2008/E) Condition 2.7, the Capture Survey Trip Report for Ma Wat River Northern Meander (Version 2) for the Project was submitted on 24 December 2013 by the Environmental Team (ET) and verified by the Independent Environmental Checker (IEC) on 6 January 2014.

The construction phase of the Contract under the EP and the Environmental Monitoring and Audit (EM&A) programme of the contract commenced on 21 November 2013. The impact environmental monitoring and audit includes air quality and noise monitoring.

This report documents the findings of EM&A works conducted in the period between 1 and 30 September 2019. As informed by the Contractor, construction activities of Contract No. HY/2012/06 in the reporting period were:

- Site clearance
- Pipe laying
- Noise Barrier
- Excavation
- Backfilling
- Sign gantry installation
- Road resurfacing
- Construction of hub room
- Landscape works

Reporting Change

There was no reporting change required in the reporting period.

Breaches of Action and Limit Levels for Air Quality

No exceedance of Action and Limit Level was recorded for 1-hour and 24-hour TSP monitoring in the reporting period.

Breaches of Action and Limit Levels for Noise

No Action or Limit Level exceedance of construction noise was recorded in the reporting month. No noise complaints related to 0700 – 1900 hours on normal weekdays was received and followed by Environmental Team in the reporting month.

Complaint, Notification of Summons and Successful Prosecution

No complaint, notification of summons and successful prosecution was received in the reporting period.

Future Key Issues

Key issues to be considered in the coming month include:

- Properly store and label oils and chemicals on site;
- Chemical, chemical waste and waste management;
- Collection of construction waste should be carried out regularly;
- Properly maintain all drainage facilities and wheel washing facilities on site;
- Exposed slopes should be covered up properly if no temporary work will be conducted;
- Quieter powered mechanical equipment should be used;
- Suppress dust generated from excavation activities and haul road traffic; and
- Tree protective measures for all retained trees should be well maintained.

1 INTRODUCTION

1.1 Background

- 1.1.1. Tolo Highway and Fanling Highway are the expressways in the North East New Territories (NENT) connecting Sha Tin, Tai Po and Fanling. These highways form a vital part of the strategic Route 9, which links Hong Kong Island to the boundary at Shenzhen. At present, this section of Route 9 is a dual 3-lane carriageway. However, at several major interchanges along this section of Route 9, the highway is a dual-2 lane carriageway only. Severe congestion is a frequent occurrence during the peak periods, particularly in the Kowloon-bound direction.
- 1.1.2. The objective of the Project "Widening of Tolo Highway / Fanling Highway between Island House Interchange and Fanling" is to widen Tolo Highway and Fanling Highway to dual 4-lane carriageway in order to alleviate the current traffic congestion problems and to cope with the increasing transport demands to and from the urban areas and also cross boundary traffic.
- 1.1.3. The Project is a designated project and governed by an Environmental Permit (EP-324/2008) issued by the EPD on 23 December 2008. Subsequently, the EPD issued Variation of Environmental Permits of EP-324/2008/A, EP-324/2008/B, EP-324/2008/C and EP-324/2008/D on 31 January 2012, 17 March 2014, 27 March 2015 and 27 August 2015 respectively. The current valid VEP was applied on 29 December 2016 and the VEP (EP-324/2008/E) was subsequently granted on 26 January 2017.
- 1.1.4. The scope of the Project comprises mainly:
 - (i) Widening of a 5.7 km section of Tolo Highway and 3.0 km section of Fanling Highway between Island House Interchange and Wo Hop Shek Interchange from the existing dual 3-lane to dual 4-lane, including construction of new vehicular bridges;
 - (ii) Widening of interchange sections at Island House Interchange, Tai Po North Interchange, and Lam Kam Road Interchange from dual 2-lane to dual 3-lane, except Sha Tin bound carriageway at Tai Po North Interchange, which is widened from 3-lane to 4-lane, including realignment of various slip roads;
 - (iii) Modification and reconstruction of highways, vehicular bridges, underpasses and footbridges.
- 1.1.5. The construction works for this Project will be delivered in 2 stages i.e. Stage 1 (between Island House Interchange and Tai Hang) and Stage 2 (between Tai Hang and Wo Hop Shek Interchange). Stage 2 would be implemented under two works contracts. Contract No. HY/2012/06 "Widening of Fanling Highway Tai Hang to Wo Hop Shek Interchange" and the entrusted portion to CEDD under Contract No. CV/2012/09 "Liantang/Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works Contract 3". In addition, Contract No. "Provision of Bus-Bus Interchange on Fanling Highway Kowloon Bound" was carried out within the site boundary of Contract No. 02/HY/2015. This report focuses on Contract No. HY/2012/06 "Widening of Fanling Highway Tai Hang to Wo Hop Shek Interchange" in Stage 2 of the Project and "Provision of Bus-Bus Interchange on Fanling Highway Kowloon Bound" under Works Order Nos. CB128520-5 and CB128519-0 in Contract No. 02/HY/2015 "Highway Department Term Contract (Management and Maintenance of Roads in Tai Po and North District excluding High Speed Roads 2016-2022)".
- 1.1.6. Hyder-Arup-Black and Veatch Joint Venture (HABVJV) are appointed by Highways Department (HyD) as the consultants for the design and construction assignment for the Tolo project under Agreement No. CE 58/2000 Supplementary Agreement No. 3 (SA3) (i.e. the Engineer for Contract No. HY/2012/06).
- 1.1.7. China State Construction Engineering (Hong Kong) Ltd. (CSHK) was commissioned as the Contractor of Contract No. HY/2012/06. Chiu Hing Construction & Transportation Company Limited (Chiu Hing) was commissioned as the Contractor of Contract No. 02/HY/2015. The construction works of Works Order Nos. CB128520-5 and CB128519-0 under Contract No. 02/HY/2015 have been completed on 23 May 2018.
- 1.1.8. AECOM Asia Co. Ltd. was commissioned by China State Construction Engineering (Hong Kong) Limited as the Environmental Team (ET) to undertake the Environmental Monitoring and Audit (EM&A)

works for the Contract and Mott MacDonald Hong Kong Ltd. acts as the Independent Environmental Checker (IEC) for the Contract.

- 1.1.9. The construction phase of the Contract under the EP commenced on 21 November 2013.
- 1.1.10. According to the updated EM&A Manual of Stage 2 of the Project, there is a need of an EM&A programme including air quality and noise monitoring. The EM&A programme for Stage 2 of the Project commenced on 21 November 2013.

1.2 Scope of Report

1.2.1 This is the seventy-second monthly EM&A Report under the Contract No. HY/2012/06 "Widening of Fanling Highway – Tai Hang to Wo Hop Shek Interchange. This report presents a summary of the environmental monitoring and audit works, list of activities and mitigation measures proposed by the ET for the Contract in September 2019.

1.3 Project Organization

1.3.1 The project organization structure is shown in Appendix A. The key personnel contact names and numbers are summarized in Table 1.1.

Table 1.1 Contact Information of Key Personnel

Party	Position	Name	Telephone	Fax
ER (Hyder-Arup-Black & Veatch Joint Venture)	Chief Resident Engineer	Edwin Chung	6115 0818	2638 0950
IEC (Mott MacDonald Hong Kong Limited)	Independent Environmental Checker	Steven Tang	2828 5920	2827 1823
Contractor of [HY/2012/06]	Fortunatel	Michael Tsang	9277 4956	2672 2501
(China State Construction Engineering (Hong Kong) Limited)	Environmental Officer	C C Chow	9679 6315	2672 2501
Contractor of [02/HY/2015] (Chiu Hing Safety Officer Months of the Construction & Transportation Company Limited)		Marty Tai	9106 5318	-
ET (AECOM Asia Company Limited)	ET Leader	Y W Fung	3922 9393	3922 9797

1.4 Summary of Construction Works

- 1.4.1 The construction phase for the Contract under the EP commenced on 21 November 2013.
- 1.4.2 Details of the construction works of Contract No. HY/2012/06 carried out by the Contractor in this reporting period are listed below:
 - Site clearance
 - Pipe laying
 - Noise Barrier
 - Excavation
 - Backfilling
 - Sign gantry installation
 - Road resurfacing
 - Construction of hub room
 - Landscape works
- 1.4.3 The Construction Programme is shown in Appendix B.
- 1.4.4 The general layout plan of the Project site of Contract No. HY/2012/06 and Works Order Nos. CB128520-5 and CB128519-0 under 02/HY/2015 showing the contract areas are shown in Figure 1.1 and Figure 1.2 respectively.
- 1.4.5 The environmental mitigation measures implementation schedule are presented in Appendix C.

1.5 Summary of EM&A Programme Requirements

- 1.5.1 The EM&A programme required environmental monitoring for air quality, noise and environmental site inspections for air quality, water quality, noise, waste management, ecology, and landscape and visual impact. The EM&A requirements for each parameter described in the following sections include:-
 - All monitoring parameters;
 - Monitoring schedules for the reporting period and forthcoming months;
 - Action and Limit levels for all environmental parameters:
 - Event / Action Plan;
 - Environmental mitigation measures, as recommended in the Project EIA study final report; and
 - Environmental requirement in contract documents.

2 AIR QUALITY MONITORING

2.1 Monitoring Requirements

2.1.1 In accordance with the updated EM&A Manual, baseline 1-hour and 24-hour TSP levels at one air quality monitoring station was established. Impact 1-hour TSP monitoring was conducted for at least three times every 6 days, while impact 24-hour TSP monitoring was carried out for at least once every 6 days. The Action and Limit level of the air quality monitoring is provided in Appendix D.

2.2 Monitoring Equipment

2.2.1 24-hour TSP air quality monitoring was performed using High Volume Sampler (HVS) located at each designated monitoring station. The HVS meets all the requirements of the updated EM&A Manual. Portable direct reading dust meters were used to carry out the 1-hour TSP monitoring. Brand and model of the equipment is given in Table 2.1.

Table 2.1 Air Quality Monitoring Equipment

Equipment	Brand and Model	
Portable direct reading dust meter (1-hour TSP)	Sibata Digital Dust Monitor (Model No. LD-3)	
High Volume Sampler (24-hour TSP)	Tisch Total Suspended Particulate Mass Flow Controlled High Volume Air Sampler (Model No. TE-5170)	

2.3 Monitoring Locations

2.3.1 The monitoring station was set up at the proposed location in accordance with updated EM&A Manual. Table 2.2 describes details of the monitoring station. The locations are shown in Figure 1.3a.

Table 2.2 Locations of Impact Air Quality Monitoring Station

Location	Monitoring Station
AM2 (SR2)	Fanling Government Secondary School

2.4 Monitoring Parameters and Frequency

2.4.1 Table 2.3 summarizes the monitoring parameters, frequency and duration of impact TSP monitoring.

Table 2.3 Air Quality Monitoring Parameters and Frequency

Parameter Frequency		
24-hour TSP	Once every 6 days	
1-hour TSP	3 times every 6 days while the highest dust impact was expected	

2.5 Monitoring Methodology

2.5.1 24-hour TSP Monitoring

- (a) The HVS was installed in the vicinity of the air sensitive receivers. The following criteria were considered in the installation of the HVS.
 - A horizontal platform with appropriate support to secure the sampler against gusty wind was provided.
 - (ii) The distance between the HVS and any obstacles, such as buildings, was at least twice the height that the obstacle protrudes above the HVS.
 - (iii) A minimum of 2 meters separation from walls, parapets and penthouse for rooftop sampler.
 - (iv) A minimum of 2 meters separation from any supporting structure, measured horizontally.
 - (v) No furnace or incinerator flues nearby.
 - (vi) Airflow around the sampler was unrestricted.
 - (vii) Permission was obtained to set up the samplers and access to the monitoring stations.
 - (viii) A secured supply of electricity was obtained to operate the samplers.
 - (ix) The sampler was located more than 20 meters from any dripline.
 - (x) Any wire fence and gate, required to protect the sampler, did not obstruct the monitoring process.
 - (xi) Flow control accuracy was kept within ±2.5% deviation over 24-hour sampling period.

(b) Preparation of Filter Papers

- (i) Glass fibre filters, G810 were labelled and sufficient filters that were clean and without pinholes were selected.
- (ii) All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ±3 °C; the relative humidity (RH) was < 50% and not variable by more than ±5%. A convenient working RH was 40%.
- (iii) All filter papers were prepared and analysed by ALS Technichem (HK) Pty Ltd., which is a HOKLAS accredited laboratory and has comprehensive quality assurance and quality control programmes.

(c) Field Monitoring

- (i) The power supply was checked to ensure the HVS works properly.
- (ii) The filter holder and the area surrounding the filter were cleaned.
- (iii) The filter holder was removed by loosening the four bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully.
- (iv) The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter.
- (v) The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied was sufficient to avoid air leakage at the edges.
- (vi) Then the shelter lid was closed and was secured with the aluminum strip.
- (vii) The HVS was warmed-up for about 5 minutes to establish run-temperature conditions.
- (viii) A new flow rate record sheet was set into the flow recorder.
- (ix) On site temperature and atmospheric pressure readings were taken and the flow rate of the HVS was checked and adjusted at around 1.1 m³/min, and complied with the range specified in the updated EM&A Manual (i.e. 0.6-1.7 m³/min).
- (x) The programmable digital timer was set for a sampling period of 24 hrs, and the starting time, weather condition and the filter number were recorded.
- (xi) The initial elapsed time was recorded.
- (xii) At the end of sampling, on site temperature and atmospheric pressure readings were taken and the final flow rate of the HVS was checked and recorded.
- (xiii) The final elapsed time was recorded.

- (xiv) The sampled filter was removed carefully and folded in half length so that only surfaces with collected particulate matter were in contact.
- (xv) It was then placed in a clean plastic envelope and sealed.
- (xvi) All monitoring information was recorded on a standard data sheet.
- (xvii) Filters were then sent to ALS Technichem (HK) Pty Ltd. for analysis.

(d) Maintenance and Calibration

- (i) The HVS and its accessories were maintained in good working condition, such as replacing motor brushes routinely and checking electrical wiring to ensure a continuous power supply.
- (ii) 5-point calibration of the HVS was conducted using TE-5025A Calibration Kit prior to the commencement of baseline monitoring. Bi-monthly 5-point calibration of the HVS will be carried out during impact monitoring.
- (iii) Calibration certificate of the HVSs are provided in Appendix E.

2.5.2 1-hour TSP Monitoring

(a) Measuring Procedures

The measuring procedures of the 1-hour dust meter were in accordance with the Manufacturer's Instruction Manual as follows:

- (i) Turn the power on.
- (ii) Close the air collecting opening cover.
- (iii) Push the "TIME SETTING" switch to [BG].
- (iv) Push "START/STOP" switch to perform background measurement for 6 seconds.
- (v) Turn the knob at SENSI ADJ position to insert the light scattering plate.
- (vi) Leave the equipment for 1 minute upon "SPAN CHECK" is indicated in the display.
- (vii) Push "START/STOP" switch to perform automatic sensitivity adjustment. This measurement takes 1 minute.
- (viii) Pull out the knob and return it to MEASURE position.
- (ix) Push the "TIME SETTING" switch the time set in the display to 3 hours.
- (x) Lower down the air collection opening cover.
- (xi) Push "START/STOP" switch to start measurement.

(b) Maintenance and Calibration

- (i) The 1-hour TSP meter was calibrated at 1-year intervals against a continuous particulate TEOM Monitor, Series 1400ab. Calibration certificates of the Laser Dust Monitors are provided in Appendix E.
- (ii) 1-hour validation checking of the TSP meter against HVS is carried out yearly at the air quality monitoring locations.

2.6 Monitoring Schedule for the Reporting period

2.6.1 The schedule for environmental monitoring in September 2019 is provided in Appendix F.

2.7 Results and Observations

2.7.1 The monitoring results for 1-hour TSP and 24-hour TSP are summarized in Table 2.4 and 2.5 respectively. Detailed impact air quality monitoring results are presented in Appendix G.

Table 2.4 Summary of 1-hour TSP Monitoring Results in the Reporting Period

Location	Average (μg/m³)	Range (μg/m³)	Action Level (μg/m³)	Limit Level (μg/m³)
AM2 (Fanling Government Secondary School)	65.5	59.2 – 76.8	317.8	500

Table 2.5 Summary of 24-hour TSP Monitoring Results in the Reporting Period

Location	Average (μg/m³)	Range (μg/m³)	Action Level (μg/m³)	Limit Level (μg/m³)
AM2 (Fanling Government Secondary School)	28.6	13.5 – 49.8	200.7	260

- 2.7.2 The major dust source during the monitoring was mainly from nearby traffic emission.
- 2.7.3 All 1-hour and 24-hour TSP results were below the Action and Limit Level at all monitoring locations in the reporting period.
- 2.7.4 The event action plan is annexed in Appendix J.
- 2.7.5 Weather information including wind speed and wind direction is annexed in Appendix H. The information was obtained from the Hong Kong Observatory Tai Po and Tai Mei Tuk Automatic Weather Stations.

3 NOISE MONITORING

3.1 Monitoring Requirements

3.1.1 In accordance with the EM&A Manual, impact noise monitoring was conducted for at least once per week during the construction phase of the Contract. The Action and Limit level of the noise monitoring is provided in Appendix D.

3.2 Monitoring Equipment

3.2.1 Noise monitoring was performed using sound level meter at each designated monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Brand and model of the equipment is given in Table 3.1.

Table 3.1 Noise Monitoring Equipment

Equipment	Brand and Model
Integrated Sound Level Meter	B&K 2238
Acoustic Calibrator	B&K 4231

3.3 Monitoring Locations

3.3.1 Monitoring stations M2 and M3 were set up at the proposed locations in accordance with updated EM&A Manual. Figure 1.3a-b shows the locations of the monitoring stations. Table 3.2 describes the details of the monitoring stations.

Table 3.2 Locations of Impact Noise Monitoring Stations

Monitoring Station	Location	Description
M2	West Tai Wo	1.2m from the ground floor free-field of the Residential
M3	Fanling Government Secondary School	1m from the exterior of the roof top façade of the school

3.4 Monitoring Parameters and Frequency

3.4.1 Table 3.3 summarizes the monitoring parameters, frequency and duration of impact noise monitoring.

Table 3.3 Noise Monitoring Parameters, Frequency and Duration

Parameter	Frequency
30-mins measurement at each monitoring station between 0700 and 1900 on normal weekdays. Leq, L10 and L90 would be recorded.	At least once per week

3.5 Monitoring Methodology

3.5.1 Monitoring Procedure

- (a) Façade measurement was made at monitoring station M3, while free-field measurement was made at monitoring station M2.
- (b) The sound level meter was set on a tripod at a height of 1.2 m above the ground for free-field measurements at monitoring station M2.
- (c) The battery condition was checked to ensure the correct functioning of the meter.
- (d) Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:-
 - (i) frequency weighting: A
 - (ii) time weighting: Fast
 - (iii) time measurement: $L_{eq(30\text{-minutes})}$ during non-restricted hours i.e. 07:00-1900 on normal weekdays; $L_{eq(5\text{-minutes})}$ during restricted hours i.e. 19:00-23:00 and 23:00-07:00 of normal weekdays, whole day of Sundays and Public Holidays
- (e) Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator for 94dB(A) at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- (f) During the monitoring period, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- (g) Noise measurement was paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations were recorded when intrusive noise was unavoidable.
- (h) Noise monitoring was cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s.

3.5.2 Maintenance and Calibration

- (a) The microphone head of the sound level meter was cleaned with soft cloth at regular intervals.
- (b) The meter and calibrator were sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- (c) Calibration certificates of the sound level meters and acoustic calibrators are provided in Appendix E.

3.6 Monitoring Schedule for the Reporting period

3.6.1 The schedule for environmental monitoring in September 2019 is provided in Appendix F.

3.7 Monitoring Results

3.7.1 The monitoring results for construction noise are summarized in Table 3.4 and the monitoring data is provided in Appendix I.

Table 3.4 Summary of Construction Noise Monitoring Results in the Reporting Period

Location	Average, dB(A),	Range, dB(A),	Limit Level, dB(A),
	L _{eq (30 mins)}	L _{eq (30 mins)}	L _{eq (30 mins)}
M2* (West Tai Wo)	67.6	65.8 – 69.7	75
M3 [#] (Fanling Government Secondary School)	62.9	60.1 – 66.2	65/70

^{*+3}dB(A) Façade correction included

[#] Limit Level of 70dB(A) applies to education institutes while 65dB(A) applies during school examination period.

- 3.7.2 No Action or Limit Level exceedance of construction noise was recorded in the reporting month. No noise complaints related to 0700 1900 hours on normal weekdays was received and followed by Environmental Team in the reporting month.
- 3.7.3 Major noise sources during noise monitoring in the reporting period were mainly road traffic noise.
- 3.7.4 The event action plan is annexed in Appendix J.

4 ENVIRONMENTAL SITE INSPECTION AND AUDIT

4.1 Site Inspection

- 4.1.1 Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Contract. In the reporting period, 5 site inspections were carried out respectively on 3, 10, 19, 24 and 30 September 2019 for the Contract. While no specific observation was recorded, recommendations on remedial actions were given to the Contractor for precautionary purpose.
- 4.1.2 The environmental site inspections summaries are provided in Appendix K.
- 4.1.3 Particular observations during the site inspections are described below:

Contract No. HY/2012/06

Air Quality

- 4.1.4 Exposed stockpile of dusty material without proper cover was observed at NB50A. The Contractor was advised to cover the exposed stockpile entirely with impervious sheeting for dust suppression.
- 4.1.5 Color-faded NRMM label was observed at NB61 and NB61A. The Contractor was advised to affix a proper NRMM label to the equipment before operation.
- 4.1.6 The Contractor was reminded to have fully cover to the stockpile stored at the SA304.
- 4.1.7 Haul road of the Construction site was observed dry. The Contractor was advised to implement water spraying frequently for dust suppression.
- 4.1.8 Dust spread was observed during cleaning works carried in the construction site. The Contractor was advised to implement water spraying during dusty work.

Noise

4.1.9 No adverse observation was identified in the reporting period.

Water Quality

4.1.10 No adverse observation was identified in the reporting period.

Chemical and Waste Management

- 4.1.11 Oil stain and chemical containers without secondary containment were observed at NB61A. The Contractor was advised to clean up the stain and provide drip trap for chemical container to prevent potential leakage.
- 4.1.12 General refuse stored without proper receptacle was observed. The Contractor was advised to sort the waste on site and store the waste properly.

Landscape and Visual Impact

4.1.13 No adverse observation was identified in the reporting period.

Miscellaneous

4.1.14 Retained waster was observed in a drip tray at NB62. The Contractor was advised to remove the retained water to avoid mosquito breeding.

4.2 Advice on the Solid and Liquid Waste Management Status

- 4.2.1 Contract No. HY/2012/06 has registered as chemical waste producers for the Contract. C&D material sorting was carried out on site. Sufficient numbers of receptacles were available for general refuse collection.
- 4.2.2 As advised by the Contractor of Contract No. HY/2012/06, 1,515 m³ of inert C&D material was generated in the reporting month (425 m³ disposed of as public fill to Tuen Mun 38, 834 m³ of inert C&D materials was reused on site, 178 m³ of inert C&D materials was reused in other projects and 78 m³ was broken concrete). For C&D wastes, 70 m³ of general refuse was disposed of at NENT landfill, 79 kg of paper/cardboard packaging, 2,548 kg of plastics and 0 kg of metals were collected by recycling Contractors, and 0 kg of chemical wastes was collected by licensed Contractors in the reporting period.
- 4.2.3 The actual amounts of different types of waste generated by the activities of the Project in the reporting period are shown in Table 4.1.

Table 4.1 Summary of Waste Flow Table for Contract No. HY/2012/06

Waste Type	Actual Amount	Disposal/Reuse Locations
Inert C&D materials disposed as public fill	425 m ³	Tuen Mun 38
Broken concrete	78 m³	Tuen Mun 38
C&D wastes disposed as general refuse	70 m³	NENT Landfill
Paper/cardboard packaging	79 kg	Recycling Facilities
Plastics	2,548 kg	Recycling Facilities
Metals	0 kg	Recycling Facilities
C&D materials reused on site	834 m ³	Site Area
C&D materials reused in other projects	178 m ³	Other projects
Chemical wastes	0 kg	Licensed Contractors

4.2.4 The Contractors were advised to maintain on-site waste sorting and recording system and maximize reuse / recycle of C&D wastes.

4.3 Environmental Licenses and Permits

4.3.1 The environmental licenses and permits for Stage 2 of the Project and valid in the reporting period is summarized in Table 4.2.

Table 4.2 Summary of Environmental Licensing and Permit Status

Statutory	License/	License or	Valid I	Period	License / Permit	Remarks
Reference	Permit	Permit No.	From	То	Holder	r tomar no
EIAO	Environment al Permit	EP-324/2008/E	26/01/2017	N/A	HyD	
WPCO	Discharge	WT-00031556- 2018	20/09/2018	30/09/2023	CSHK	
WPCO	License (Site)	WT00027968- 2017	22/05/2017	31/05/2022	Chiu Hing	

Statutory	License/	License or	Valid	Period	License / Permit	Remarks
Reference	Permit	Permit No.	From	То	Holder	Remarks
WDO	Chemical Waste Producer Registration	5213-722- C3822-01	05/09/2013	N/A	CSHK	Chemical waste produced in Contract HY/2012/06
WDO	Billing Account for Disposal of	7017860	N/A	N/A	CSHK	Waste disposal in Contract HY/2012/06
WBG	Construction Waste	7024392	N/A	N/A	Chiu Hing	Waste disposal in Contract 02/HY/2015
	Notification Under Air Pollution	361991	15/07/2013	N/A	CSHK	
APCO	Control (Constructio n Dust) Regulation	414360	08/03/2017	N/A	Chiu Hing	
		GW-RN0351-19	5-Jun-2019	13-Oct-2019	CSHK	NB, Zone 1 Laying of Cross Road Duct
		GW-RN0412-19	25-Jun-2019	31-Oct-2019	CSHK	Zone 1 & 2 Installation of Streetlight Pole Road Marking Alternation
		GW-RN0590-19	28-Aug- 2019	31-Oct-2019	CSHK	Zone 1 & 2 Road Marking Alternation
		GW-RN0424-19	25-Jun-2019	31-Oct-2019	CSHK	Zone 1&2A Road Resurfacing
NCO	Construction Noise	GW-RN0570-19	25-Aug- 2019	31-Oct-2019	CSHK	Zone 1 & 2 Sign Gantry Installation
	Permit	GW-RN0223-19	13-Apr- 2019	20-Sep-2019	CSHK	Zone 2B Tai Wo Footbridge Concreting
		GW-RN0427-19	6-Jul-2019	31-Oct-2019	СЅНК	Zone 2B Road resurfacing between CH21.7 and CH22.5
		GW-RN0273-19	27-Apr- 2019	7-Sep-2019	CSHK	Zone 4 Sign Gantry Installtion
		GW-RN0436-19	26-Jun-2019	31-Oct-2019	CSHK	Zone 4 Tree Felling

Statutory	License/	License or	Valid	Period	License / Permit	Remarks
Reference	Permit	Permit No.	From	То	Holder	Tromaine
		GW-RN0560-19	12-Aug- 2019	8-Oct-2019	CSHK	Zone 4 Road Marking Alternation betweem CH23.8 - CH24.2
		GW-RN0602-19	26-Aug- 2019	25-Oct-2019	CSHK	Zone 4 Laying of cross road duct at Pak Wo Road
		GW-RN0600-19	26-Aug- 2019	25-Oct-2019	CSHK	Pak Wo Road, Zone 4 Road Resurfacing
		GW-RN0601-19	26-Aug- 2019	25-Oct-2019	CSHK	NB, Zone 4 Road Marking Alternation betweem CH23.4 - CH24.1
		GW-RN0613-19	2-Sep-2019	31-Oct-2019	CSHK	SB, Zone 4 Road Resurfacing CH23.4 - CH24.3
		GW-RN0659-19	24-Sep-2019	31-Oct-2019	СЅНК	NB, near Hong Lok Yuen Road Resurfacing CH20.6 - CH21.7

4.4 Implementation Status of Environmental Mitigation Measures

4.4.1 A summary of the Implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in Appendix C.

4.5 Summary of Exceedances of the Environmental Quality Performance Limit

- 4.5.1 All 1-hour and 24-hour TSP monitoring results complied with the Action / Limit Levels in the reporting period.
- 4.5.2 No Action or Limit Level exceedance of construction noise was recorded in the reporting month. No noise complaints related to 0700 1900 hours on normal weekdays was received and followed by Environmental Team in the reporting month.
- 4.6 Summary of Complaints, Notification of Summons and Successful Prosecutions
- 4.6.1 The Environmental Complaint Handling Procedure is annexed in Figure 4.1.
- 4.6.2 No complaint, notification of summons and successful prosecution was received in the reporting period.
- 4.6.3 Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix L.

5 FUTURE KEY ISSUES

5.1 Construction Programme for the Coming Months

- 5.1.1 The major construction works for Contract No. HY/2012/06 in October 2019 will be:
 - Site clearance
 - Noise Barrier
 - Excavation
 - Backfilling
 - Sign gantry installation
 - Road resurfacing
 - Landscape works

5.2 Key Issues for the Coming Month

- 5.2.1 Key issues to be considered in October 2019:
 - Properly store and label oils and chemicals on site;
 - Chemical, chemical waste and waste management;
 - Collection of construction waste should be carried out regularly;
 - Properly maintain all drainage facilities and wheel washing facilities on site;
 - Exposed slopes should be covered up properly if no temporary work will be conducted;
 - Quieter powered mechanical equipment should be used;
 - Suppress dust generated from excavation activities and haul road traffic; and
 - Tree protective measures for all retained trees should be well maintained.

5.3 Monitoring Schedule for the Coming Month

5.3.1 The tentative schedule for environmental monitoring in October 2019 is provided in Appendix F.

6 CONCLUSIONS AND RECOMMENDATIONS

6.1 Conclusions

- 6.1.1 The construction phase and EM&A programme of the Contract commenced on 21 November 2013.
- 6.1.2 All 1-hour and 24-hour TSP monitoring results complied with the Action / Limit Levels in the reporting period.
- 6.1.3 No Action or Limit Level exceedance of construction noise was recorded in the reporting month. No noise complaints related to 0700 1900 hours on normal weekdays was received and followed by Environmental Team in the reporting month.
- 6.1.4 5 environmental site inspections were carried out in September 2019. Recommendations on remedial actions were given to the Contractors for the deficiencies identified during the site audits.
- 6.1.5 No complaint, notification of summons and successful prosecution was received in the reporting period.

6.2 Recommendations

6.2.1 According to the environmental site inspections performed in the reporting period, the following recommendations on remedial actions were provided to the Contractor for precautionary purpose:

Contract No. HY/2012/06

Air Quality Impact

- The Contractor was advised to cover the exposed stockpile entirely with impervious sheeting for dust suppression.
- The Contractor was advised to affix a proper NRMM label to the equipment before operation.
- The Contractor was advised to implement water spraying on the haul road frequently for dust suppression.
- The Contractor was advised to implement water spraying during dusty work.

Noise Impact

No adverse observation was identified in the reporting period.

Water Quality Impact

• The Contractor was advised to provide drip tray for the chemical containers to prevent potential leakage.

Chemical and Waste Management

- The Contractor was advised to clean up the stain and provide drip trap for chemical container to prevent potential leakage.
- The Contractor was advised to sort the waste on site and store the waste properly.


Landscape and Visual Impact.

No adverse observation was identified in the reporting period.

Miscellaneous

The Contractor was advised to remove the retained water to avoid mosquito breeding.

FIGURES

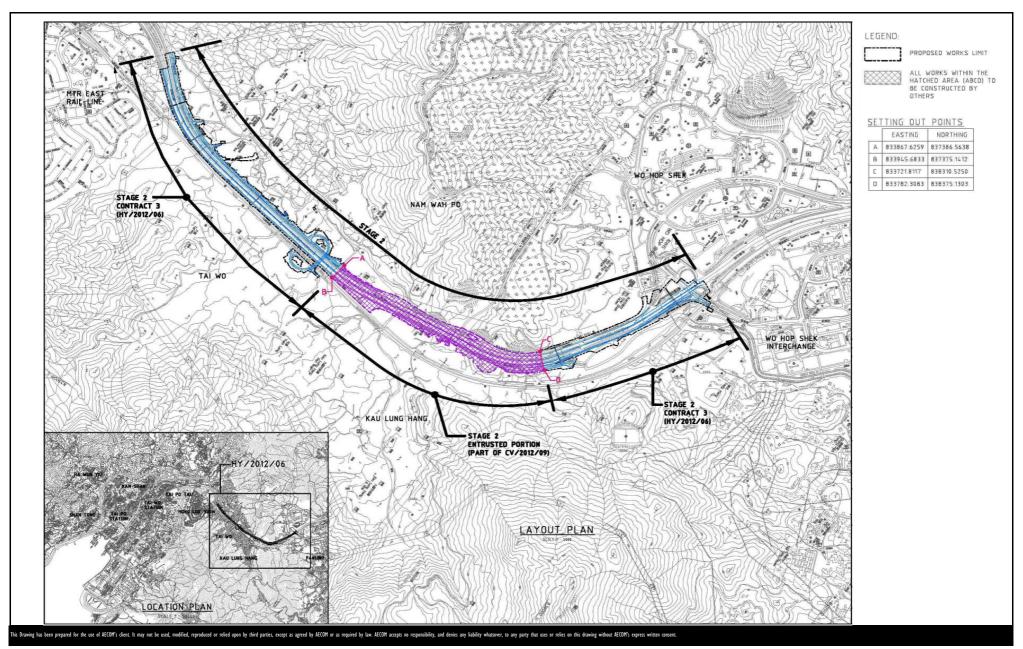

CONTRACT NO. HY/2012/06


WIDENING OF FANLING HIGHWAY

- TAI HANG TO WO HOP SHEK INTERCHANGE

AECOM

Layout Plan


Date: Dec 2013 Figure 1.1

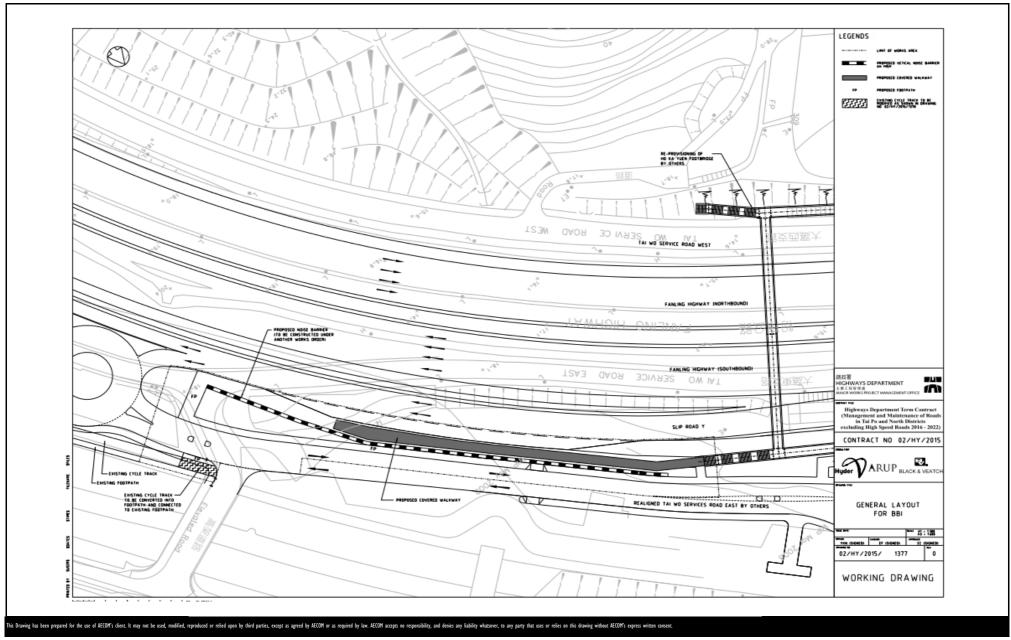

CONTRACT NO. 02/HY/2015

PROVISION OF BUS-BUS INTERCHANGE ON FANLING HIGHWAY KOWLOON BOUND




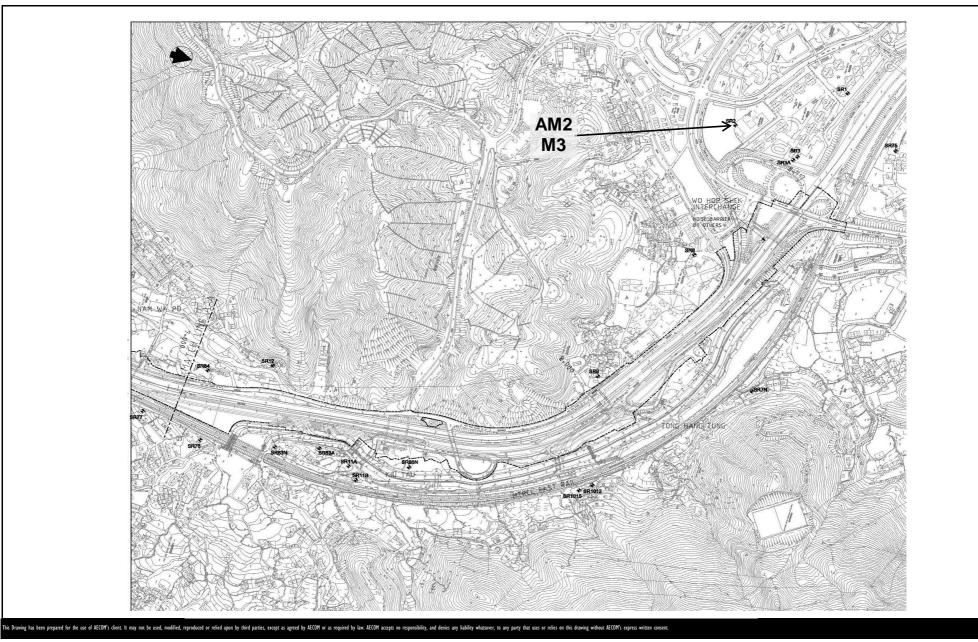

CONTRACT NO. HY/2012/06
WIDENING OF FANLING HIGHWAY

- TAI HANG TO WO HOP SHEK INTERCHANGE

AECOM

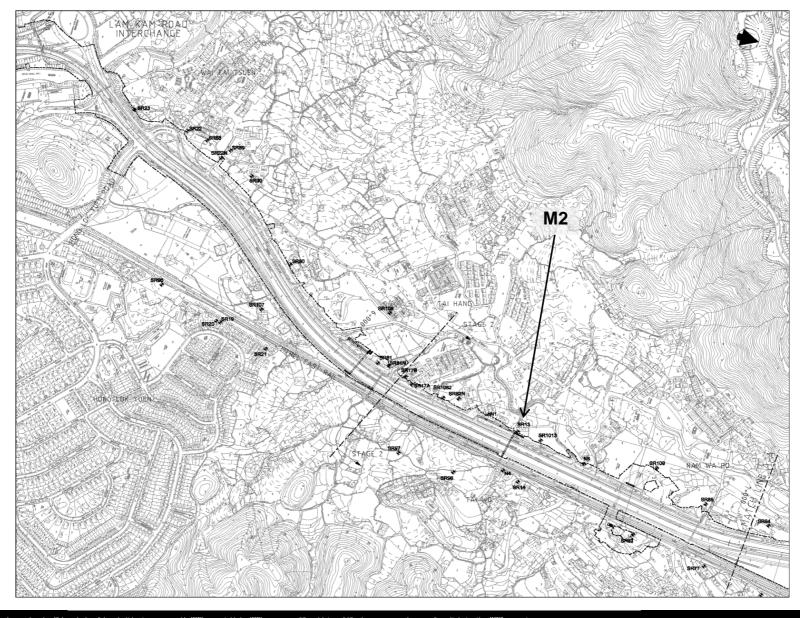

This Drawing has been prepared for the use of AECOM's circuit. It may not be used, modified, reproduced or relied upon by third parsies, except as agreed by AECOM or as required by law. AECOM excepts no responsibility, and denies any liability whatsover, to any party that uses or relies on this drawing without AECOM's express written consont.


WIDENING OF FANLING HIGHWAY

CONTRACT NO. HY/2012/06

- TAI HANG TO WO HOP SHEK INTERCHANGE



Date: Dec 2013 Figure 1.3b

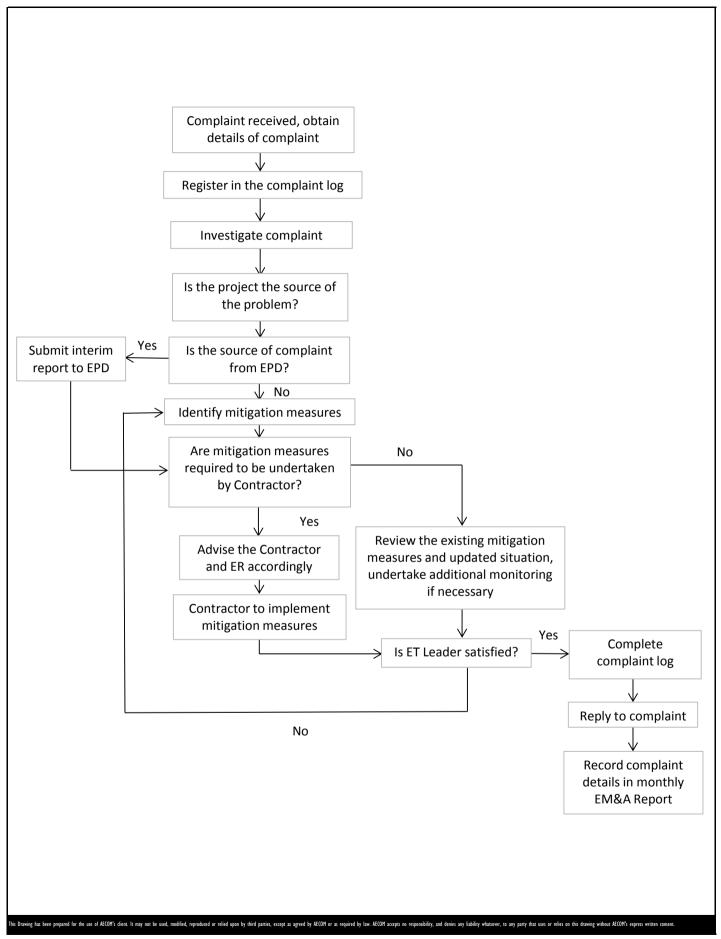


CONTRACT NO. HY/2012/06
WIDENING OF FANLING HIGHWAY

- TAI HANG TO WO HOP SHEK INTERCHANGE



Project No.: 60307376 Date: Dec 2013 Figure 4.1

APPENDIX A PROJECT ORGANIZATION STRUCTURE

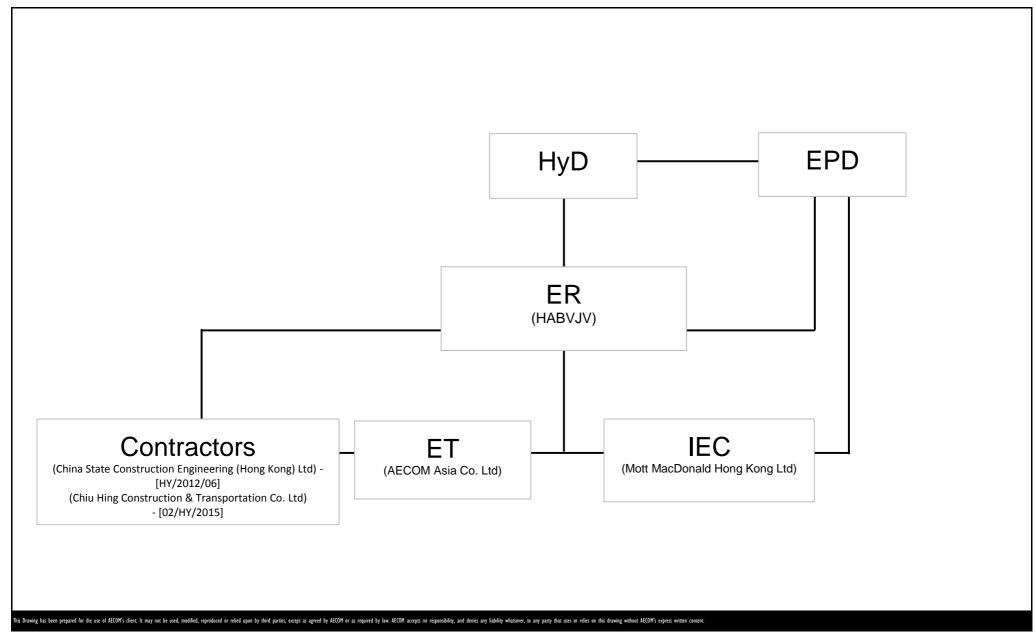

CONTRACT NO. HY/2012/06


WIDENING OF FANLING HIGHWAY

- TAI HANG TO WO HOP SHEK INTERCHANGE



Project No.: 60307376 Date: Apr 2017 Appendix A

APPENDIX B CONSTRUCTION PROGRAMMES

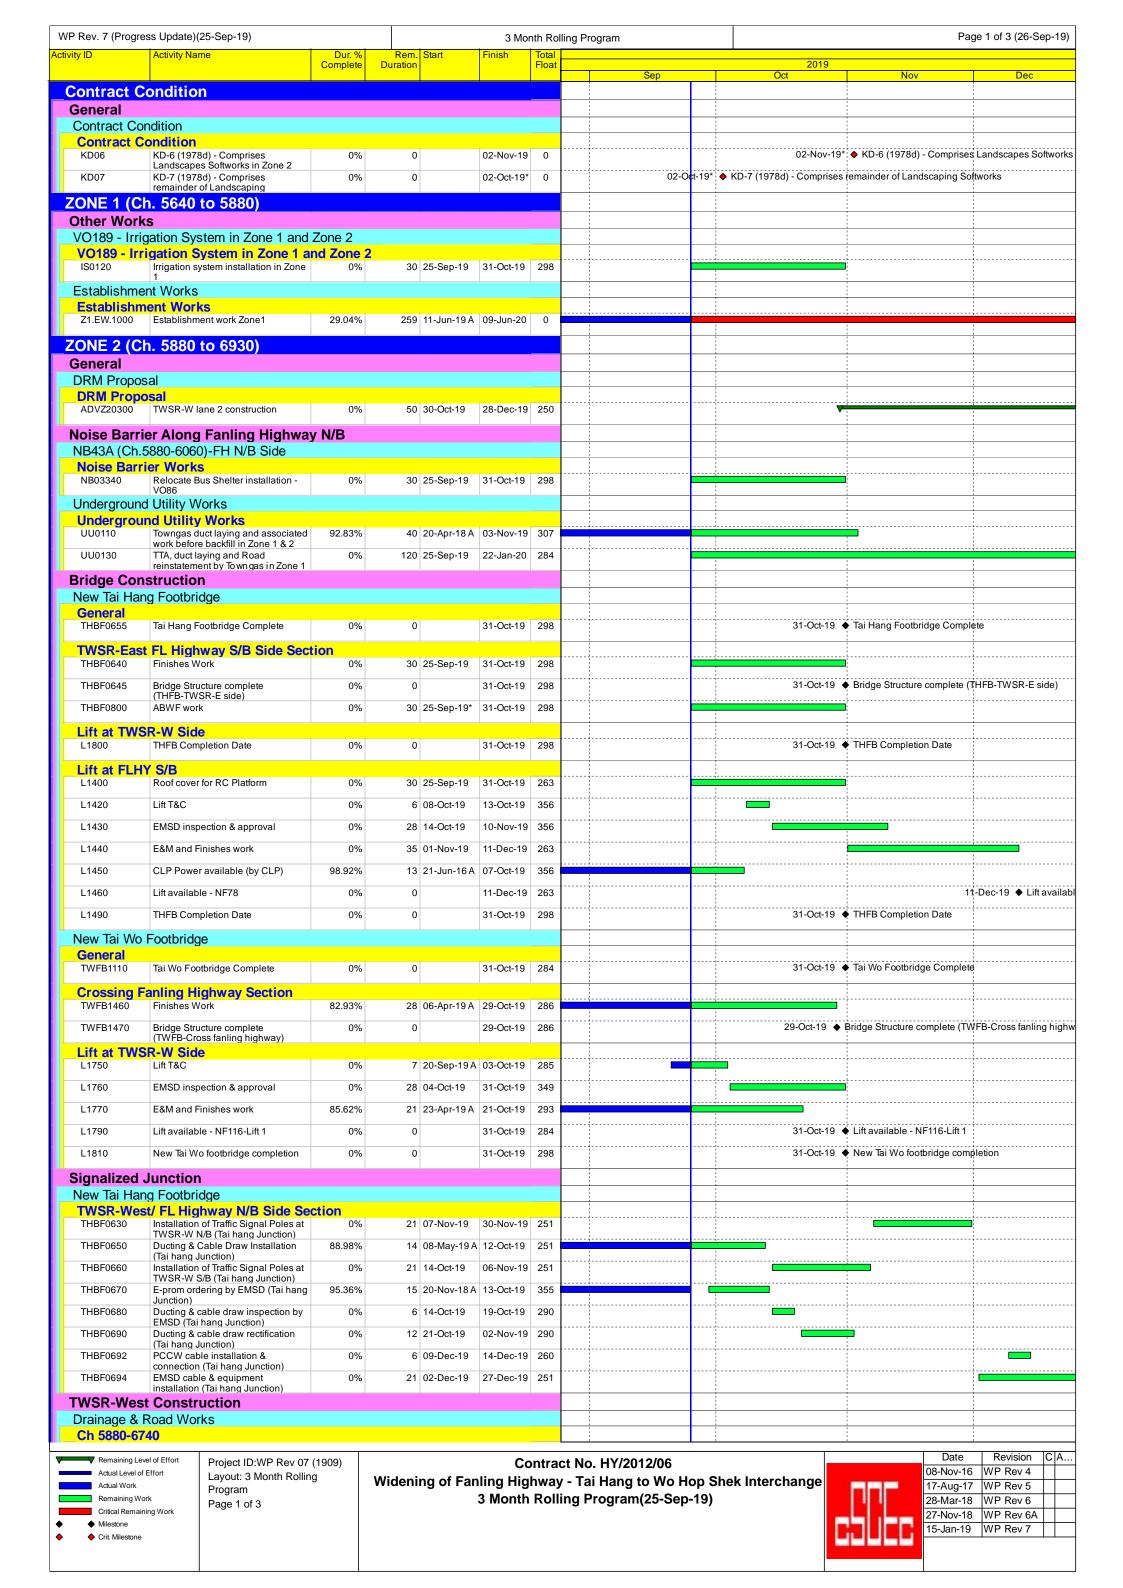

	Activity Name	Dur. % Complete	Rem. Start Duration	Finish	Total Float				2019		
RDZ20170	Z2 : New TWSR-West road Works	0%		28-Dec-19			Sep		Oct	Nov	Dec
ther Work	(lane 2)										1
CSS Works											
	sion for TCSS Works										
TCSS2140	M10 for CCTV	0%		16-Nov-19					 		
TCSS2180	Pillar box, isolator & associated duct work - PL204 for G30 & G55	0%		15-Oct-19							
TCSS2190	Pillar box, isolator & associated duct work - PL205 for G54 & M10	0%	16 25-Sep-19	15-Oct-19	312	l					
TCSS2200	Pillar box, isolator & associated duct work - PL206 for G32	0%	16 25-Sep-19	15-Oct-19	312						1
TCSS2270	Civil Provision for TCSS works available (Zone 2)	0%	0	15-Oct-19	312				15-Oct-19 ♦ Civil Provision	for TCSS works available (2	Zone 2)
354											
TCSS2120	Sign Gantry Erection - G54	61.9%	8 04-Sep-19 A	04-Oct-19	320						
	gation System in SA328 and										1
<mark>/O184 - Irri</mark> IS0140	igation System in SA328 ar Irrigation system installation in	ad SA329 33.33%	32 04-Sep-19 A	02-Nov-19	9 0	ļ				<u> </u>	
	SA328 and SA329		32 04-36P-13A	02-1101-13		-				<u> </u>	
	gation System in Zone 1 and igation System in Zone 1 a					 			 		1
IS0130	Irrigation system installation in Zone	33.33%	32 04-Sep-19 A	02-Nov-19	9 0	·					
andscape S	Softwork								 	 	1 1 1
andscape	Works										1
Z2.LW.1000	Landscape soft work Zone2	0%	32 25-Sep-19	02-Nov-19	9 0						
stablishme											
<mark>Establishm</mark> Z2.EW.1000	ent Works Establishment work Zone2	0%	365 02-Nov-19	01-Nov-20	0 0	 			 	1	
		0 /0	230 32 1407-19		, v						
	Tai Hang (VO126)										1
	ai Hang (VO126) ai Hang (VO126)										
Pai Lau in 1	Tai Hang (VO126)										1
PL00995	VO126 Suspension on 20-Feb-19 (HY/2012/06)/M15/220.126/(5)	97.21%	5 20-Feb-19 A	30-Sep-19	187	!					
PL01000	Works area access date (14-Dec-2018)	0%	0 02-Oct-19		187				♦ Works area access date (1	4-Dec-2018)	
PL01010	CLP relocation of Overhead Cable	0%	12 25-Sep-19*	10-Oct-19	210					<u></u>	
PL01020	Excavation	0%	12 02-Oct-19	16-Oct-19	187					 	
PL01030	Footing	0%	12 17-Oct-19	30-Oct-19	187	 				 	1
PL01040	backfill	0%		06-Nov-19		 				1	
PL01050	Pai Lau Superstructure	0%		24-Jan-20		ļļ.					
	·					<u> </u>					
PL01060	Material submission for finishes works	92.55%	21 05-Nov-18 A								
PL01070	Material submission approval	0%		25-Nov-19							
PL01080	Material Order & delivery on site	0%	45 26-Nov-19	20-Jan-20	191					_	1 1 1
outh Buffe	er Zone 1 (SBZ1) (with	in Zone	2)(Ch.6740 to	6930)							1
ridge Cons											1
	ang Vehicular Bridge e - West Ramp					 					
KLH Bridge KLH.1290	West Ramp - Planting	0%	21 25-Sep-19	21-Oct-19	307					 	
KLH Bridge	- Deck 1					+			 		1
KLH.3430	Deck 1 - Planting	0%	21 25-Sep-19	21-Oct-19	307					-}	· - [
KLH Bridge	e - Deck 3					l i					1
KLH.3500	Deck 3 - Planting	0%	21 25-Sep-19	21-Oct-19	307					1	
KI H Bridge	e - East Ramp										
	East Ramp - Planting	0%	34 25-Sep-19	05-Nov-19	294				1		i
		0 70	3 1 23 33p 13	1		 			i	i	
KLH.3590 <mark>KLH Bridge</mark>	e - Staircase S1										
KLH.3590 <mark>KLH Bridge</mark> Z2.KLH.1500	e - Staircase S1 S1 - Roof steel frame installation	18.92%	30 11-Sep-19 A								
KLH.3590 <mark>KLH Bridge</mark> Z2.KLH.1500	e - Staircase S1		30 11-Sep-19 A	31-Oct-19 21-Nov-19							
KLH.3590 (LH Bridge Z2.KLH.1500 Z2.KLH.1750	e - Staircase S1 S1 - Roof steel frame installation	18.92%	30 11-Sep-19 A 18 01-Nov-19		9 268						
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760	S1 - Corrugated steel roof	18.92%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19	21-Nov-19	9 268						
KLH.3590 (LH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770	S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works	18.92% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19	21-Nov-19 05-Dec-19	9 268						
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 3ridge Roa	S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works	18.92% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19	21-Nov-19 05-Dec-19 05-Dec-19	9 268 9 268 9 268						
KLH 3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS	S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side	18.92% 0% 0% 0% 78.13%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A	21-Nov-19 05-Dec-19 05-Dec-19	9 268 9 268 9 268 9 293						
KLH 3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040	S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB	18.92% 0% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19	21-Nov-19 05-Dec-19 05-Dec-19	9 268 9 268 9 268 9 293						
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130	S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side	18.92% 0% 0% 0% 78.13%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A	21-Nov-19 05-Dec-19 05-Dec-19	9 268 9 268 9 268 9 293 320		04	1-Oct-1	9 ♦ Lift available - NF117-Lif	11	
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150	ST - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works CWORK Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1	18.92% 0% 0% 0% 78.13%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19	9 268 9 268 9 268 9 293 320		04	1-Oct-1	9 ♦ Lift available - NF117-Lif	11	
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150 ignalized Lau Lung Ha	S-Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge	18.92% 0% 0% 0% 78.13%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19	9 268 9 268 9 268 9 293 320		02	4-Oct-1	9 ♦ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150 gnalized au Lung Ha KLH Bridge	S - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp	18.92% 0% 0% 0% 78.13% 94.94% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19	9 268 9 268 9 268 9 293 9 293 320		04	4-Oct-1	9 ◆ Lift available - NF117-Lif	(1	
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01150 ignalized au Lung Ha KLH Bridge Z2.KLH.1032	S-Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB)	18.92% 0% 0% 0% 78.13% 94.94% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19	9 268 9 268 9 268 9 293 320 320		04	I-Oct-1	9 ♦ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lott at TWS Lott by L	e - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB)	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 30-Nov-19	9 268 9 268 9 268 9 293 320 320 320 251 251		04	I-Oct-1	9 ♦ Lift available - NF117-Lif	11	
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lott at TWS Lott by L	S-Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation	18.92% 0% 0% 0% 78.13% 94.94% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19	9 268 9 268 9 268 9 293 320 320 320 251 251		04	-Oct-1	9 ♦ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 L01150 ignalized Lung Ha KLH Bridge Z2.KLH.1032 Z2.KLH.1042 Z2.KLH.1052	ST - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & cable draw inspection by	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 30-Nov-19	9 268 9 268 9 268 9 293 320 320 9 251 251 9 251		Oz	I-Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lotton Lot	ST - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 06-Nov-19	268 268 268 268 268 29 29 320 320 320 251 251 284		04	Oct-1	9 ♦ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 3ridge Roa Z2.KLH.2040 ift at TWS L01130 L01150 gnalized au Lung Ha KLH Bridge Z2.KLH.1032 Z2.KLH.1052 Z2.KLH.1052 Z2.KLH.1072 Z2.KLH.1082	ST - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & Cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation &	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 30-Nov-19 12-Oct-19 19-Oct-19	9 268 9 268 9 268 9 293 9 293 320 320 9 251 251 251 284		02	I-Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 3ridge Roa Z2.KLH.2040 Loff at TWS Loff at TWS Loff at Lung Ha KLH Bridge Z2.KLH.1032 Z2.KLH.1052 Z2.KLH.1052 Z2.KLH.1052 Z2.KLH.1072 Z2.KLH.1082 Z2.KLH.1092	e - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 12-Oct-19 19-Oct-19 02-Nov-19	9 268 9 268 9 268 9 293 320 320 320 9 251 251 251 284 9 284		04	I-Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150 L01150 L01150 LMART LUNG Hak KLH Bridge Z2.KLH.1032 Z2.KLH.1042 Z2.KLH.1052 Z2.KLH.1072 Z2.KLH.1082 Z2.KLH.1092 Z2.KLH.11092 Z2.KLH.1102	STAIRCASE S1 S1 - Roof steel frame installation S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment installation (KLHVB)	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19 21 02-Dec-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 19-Oct-19 07-Dec-19 27-Dec-19	9 268 9 268 9 268 9 293 320 320 320 251 251 284 9 260 9 251		04	I-Oct-1	9 ♦ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Loff at TWS Loff at TWS Loff at Lung Ha KLH Bridge Z2.KLH.1032 Z2.KLH.1052 Z2.KLH.1052 Z2.KLH.1052 Z2.KLH.1092 Z2.KLH.1092 Z2.KLH.1102 Drth Buffe	ST - Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & Cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment installation (KLHVB) EMSD cable & equipment installation (KLHVB) EMSD cable 2 (NBZ2) (with	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19 21 02-Dec-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 19-Oct-19 07-Dec-19 27-Dec-19	9 268 9 268 9 268 9 293 320 320 320 251 251 284 9 260 9 251		Oz	I-Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150 ignalized Lau Lung Ha KLH Bridge Z2.KLH.1032 Z2.KLH.1042 Z2.KLH.1052 Z2.KLH.1082 Z2.KLH.1092	ST-Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & Cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment installation (KLHVB) EMSD cable & equipment installation (KLHVB) ET Zone 2 (NBZ2) (withstair was a struction	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0% 0% 0%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19 21 02-Dec-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 19-Oct-19 07-Dec-19 27-Dec-19	9 268 9 268 9 268 9 293 320 320 320 251 251 284 9 260 9 251		04	i-Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 L01150 L01150 L01150 L01150 LUNG Hak KLH Bridge Z2.KLH.1032 Z2.KLH.1052 Z2.KLH.1072 Z2.KLH.1092 Z2.KLH.1092 Z2.KLH.1092 Z2.KLH.1092 Z2.KLH.1092 CTTH Buffer LOTIC CONSIDER CO	ST-Staircase S1 S1-Roof steel frame installation S1-Corrugated steel roof S1-Handrail S1-Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & Cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment installation (KLHVB) PT Zone 2 (NBZ2) (with struction Yuen Footbridge t/ FL Highway N/B Side See	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0% 0% 0% 0% 0% in Zone	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19 21 02-Dec-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 19-Oct-19 07-Dec-19 27-Dec-19	9 268 9 268 9 268 9 293 320 320 320 251 251 284 9 260 9 251		02	I-Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 Bridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150 L01150 L01150 LM Bridge Z2.KLH.1032 Z2.KLH.1032 Z2.KLH.1042 Z2.KLH.1052 Z2.KLH.1072 Z2.KLH.1092 Z2.KLH.1092 Z2.KLH.1092 Z2.KLH.1092 LOTTH Buffe LOTTH Buff LOTTH Buffe LOTTH Buffe LOTTH Buff LO	ST-Staircase S1 S1 - Roof steel frame installation S1 - Corrugated steel roof S1 - Handrail S1 - Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction and Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & Cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment installation (KLHVB) EMSD cable & equipment installation (KLHVB) EMSD cable & (NBZ2) (with struction Yuen Footbridge	18.92% 0% 0% 0% 78.13% 94.94% 0% 91.08% 0% 0% 0% 0% 0% in Zone	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19 21 02-Dec-19	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 06-Nov-19 19-Oct-19 07-Dec-19 27-Dec-19	9 268 9 268 9 268 9 293 9 293 9 320 320 9 251 251 284 9 284 9 260 9 251		04	Oct-1	9 ◆ Lift available - NF117-Lif		
KLH.3590 KLH Bridge Z2.KLH.1500 Z2.KLH.1750 Z2.KLH.1760 Z2.KLH.1770 3ridge Roa Z2.KLH.2040 Lift at TWS L01130 L01150 ignalized Lau Lung Ha KLH Bridge Z2.KLH.1032 Z2.KLH.1042 Z2.KLH.1052 Z2.KLH.1072 Z2.KLH.1082 Z2.KLH.1092	ST-Staircase S1 S1-Roof steel frame installation S1-Corrugated steel roof S1-Handrail S1-Lighting & finishes works d Work Landscape work of KLHVB R-W Side Finishes work Lift available - NF117-Lift 1 Junction ang Vehicular Bridge - West Ramp Installation of Traffic Signal Poles at TWSR-W N/B (KLHVB) Ducting & Cable Draw Installation (KLHVB) Installation of Traffic Signal Poles at TWSR-W S/B (KLHVB) Ducting & Cable draw inspection by EMSD (KLHVB) Ducting & cable draw rectification (KLHVB) PCCW cable installation & connection (KLHVB) EMSD cable & equipment installation (KLHVB) PT Zone 2 (NBZ2) (with struction Yuen Footbridge t/ FL Highway N/B Side See	18.92%	30 11-Sep-19 A 18 01-Nov-19 12 22-Nov-19 12 22-Nov-19 35 23-Apr-19 A 8 20-Mar-19 A 0 21 07-Nov-19 14 28-Mar-19 A 21 14-Oct-19 6 14-Oct-19 12 21-Oct-19 6 02-Dec-19 21 02-Dec-19 4) (Ch. 7925 to	21-Nov-19 05-Dec-19 05-Dec-19 06-Nov-19 04-Oct-19 04-Oct-19 12-Oct-19 06-Nov-19 19-Oct-19 07-Dec-19 27-Dec-19	9 268 9 268 9 268 9 293 9 293 9 320 320 9 251 251 284 9 284 9 260 9 251		02	I-Oct-1	9 ◆ Lift available - NF117-Lif		

ty ID	ss Update)(25-Sep-19) Activity Name	Dur. %	Rem.	Start	3 Mo	Total	9 /				
		Complete	Duration			Float		Sep	2019 Oct	Nov	Dec
DI0220	DN450 DI watermain laying at TWSR-W (CHA 2070)	0%	15	17-Oct-19	02-Nov-19	251					
DI0230	DN450 DI watermain laying at TWSR-W (CHA 2200)	97.47%	2	20-Jun-19 A	26-Sep-19	251					
DI0240	DN450 DI watermain laying at TWSR-W (CHA 2370)	0%	15	27-Sep-19	16-Oct-19	251	1	[!		
Bridge Cons											
	Shek Pedstrian & Cycle Br	idge									
General			_				.			10 A W 11 O 1 D 1	
WHS1110	Wo Hop Shek Bridge Complete	0%	0		05-Nov-19	294			05-	Nov-19 ♦ Wo Hop Shek Bridge	Complete
TWSR-Wes WHS1420	tt/ FL Highway N/B Side Se Ramp Finishes Work	ction 91.28%	24	13-Jul-18 A	05-Nov-19	204		ļ		·	
	<u>'</u>			13-Jul-16 A							
WHS1430	Bridge Structure complete (WHS-TWSR-W side)	0%	0		05-Nov-19	-			05-	Nov-19 ◆ Bridge Structure com	piete (WHS-TWSR-
	ditional Retaining Wall in Zon	e 4 Near a	at Grade	Cycle Tra	ck and Fo	ootr					
Cycle Track WHS1460	TTA for closure of slip Y lane 1 for	0%	3	10-Oct-19*	12-Oct-19	143					
WHS1560	material delivery				09-Nov-19						
	Retaining Wall construction	0%		14-Oct-19			ļ			·	
WHS1570	Concrete Footing for railing	0%	10	11-Nov-19	21-Nov-19	143	1	<u> </u>			
WHS1580	Concrete Footing for Expressway boundary fence	0%	10	22-Nov-19	03-Dec-19	143					
WHS1590	300 U-channel	0%	12	04-Dec-19	17-Dec-19	191	1				
WHS1600	backfill	0%	3	18-Dec-19	20-Dec-19	191	 				
WHS1610	Cycle Track sub-base & wearing	0%	6	21-Dec-19	30-Dec-19	191					
Footnath	course									 	
Footpath WHS2150	Concrete Footing for railing	0%	15	04-Dec-19	20-Dec-19	143		<u> </u>			
WHS2160	Concrete Footing for Expressway	0%	15	21-Dec-19	10-Jan-20	143	 	<u> </u>			
	boundary fence	5,0	.5		22 23						
FWSR-West Drainage & F	t Construction								; ;		
	t/ FL Highway N/B Side Se	ction									
RDZ41180	TWSR -W Road Works rectification	0%	18	04-Nov-19	23-Nov-19	278					
Slin Road Y	Construction										
Drainage & F											
TWSR-East	FL Highway S/B Side Sec										
RDZ41080	Construct Slip Rd Y- 2nd lane (Ch8370-8650)(SA340) (Z4	90.35%	11	20-May-19 A	09-Oct-19	5					
RDZ41089	Slip Road Y (Ch7925-8650) complete	0%	0		09-Oct-19	5	Ī	(09-Oct-19 ♦ Slip Road Y (Cl	17925-8650) complete	
anling Hig	hway Construction										
Drainage & F	Road Works										
TWSR-Wes	t/ FL Highway N/B Side Se		10	00.140.4	00.0.140	040					
RDZ41170	Complete Slip road V and associated slope work	88.51%	10	20-Jun-19 A	08-Oct-19	318			1		
Other Work											
TCSS Works	S Construction Works										
TCSS0180	Sign Gantry Factory production - FVMS1 (Deleted)	0%	0	25-Sep-19	25-Sep-19	328		İ			
Civil Provis	FVMS1 (Deleted)			·							
TCSS2160	P51 for VSLS	0%	14	10-Oct-19	25-Oct-19	5		ļ			
TCSS2170	P52 for VSLS	0%	14	10-Oct-19	25-Oct-19	5	 	<u> </u>			
TCSS2210	Pillar box, isolator & associated duct	0%			05-Dec-19		ļ				
	work - PL207 for G34 & G35						ļ				
TCSS2230	Pillar box, isolator & associated duct work - PL251 for G51	0%	30	06-Dec-19	13-Jan-20	208					
DS50	0' 0 Funding D050 (74)	00/	0	05.0	05.0	000					
TCSS1850	Sign Gantry Erection - DS50 (Z4) (Deleted by Verbal instruction , VO is	0%	0	25-Sep-19	25-Sep-19	328					
TCSS Hub I		400/	0.7	00.4 . 40.4	00.0.140	050			<u> </u>		
TCSS1910	TCSS Hub Room Finishes	40%		29-Aug-19 A			ļ				
TCSS1920	TCSS Hub Room BS provision	0%	45	29-Oct-19	19-Dec-19	256					
	gation System near Ho Ka Yu										
VO190 - Irri IS160	igation System near Ho Ka Irrigation system installation near Ho			04-Sep-19 A	02-Oct-10	0	ļ				
	Ka Yuen Footbridge	13.91%	р	о ое р-19 А	02-00-19	U			!		
Landscape S									! !		
Landscape Z4.LW.1000	Landscape soft work Zone4	73.91%	6	04-Sep-19 A	02-Oct-19	0			<u>-</u>		
Establishme	<u>'</u>									1	
Establishm										1	1
Z3.EW.1000	Establishment work Zone4	0%	365	03-Oct-19	01-Oct-20	0				· · · · · · · · · · · · · · · · · · ·	1
VO Relocation	on of Traffic Sign at Pak Wo	Road & J	ockev Cli	ub Road						i i i	
VO Relocat	ion of Traffic Sign at Pak V	Vo Road	& Jockey	Club Ro				-			
TS01030	TTA submission & approval	50%		02-Sep-19 A		196					
TS01040	TTA	0%	2	15-Oct-19	16-Oct-19	196	1		•		
TS01050	Sheet piling & excavation	0%	18	17-Oct-19	06-Nov-19	196				····	
TS01060	Footing (FL02, ADS52)	0%	45	07-Nov-19	31-Dec-19	196	 	İ			
TS1160	XP application period - Jockey Club	41.75%	60	08-Aug-19 A	23-Nov-19	201					!
TS1180	Road TTA	0%			26-Nov-19		ļ <u>-</u>				
							ļ	ļ			
TS1190	Sheet piling & excavation	0%		27-Nov-19	17-Dec-19		ļ				!
TS1200	Footing (DS53, FL01)	0%	45	18-Dec-19	13-Feb-20	161					
	ks in Traffic Signalized Junc	tion at Pa	k Wo Roa	ad							
WHS Interc	:hange				44.51	4	ļ				
TSJ01050	Duct Laying (Road Crossing) - Pak Wo Road	7.14%		17-Sep-19 A			ļ				
TSJ01160	Duct Laying and Drawpit construction (Along Existing Slope	0%	43	12-Nov-19	03-Jan-20	140					1
	ad and Jockey Club Road										
TSJ01260	Existing MJ modified by HyD structure	0%	48	08-Oct-19*	02-Dec-19	0					
TSJ01270	Road Construction & reinstatement	0%	35	03-Dec-19	15-Jan-20	130	†				
	(new 2nd stage after MJ		/I ENO	D)				:			1
Commissio	ning of Traffic Signalized.	Junction	(DV FIVISI	וט				1		1	1

APPENDIX C
IMPLEMENTATION SCHEDULE OF
ENVIRONMENTAL MITIGATION MEASURES
(EMIS)

Appendix C - Implementation Schedule of Environmental Mitigation Measures (EMIS)

Air Quality - Schedule of Recommended Mitigation Measures

Impact	Mitigation Measures	Timing	Implementation Status
Air Quality during construction	Restricting heights from which materials are dropped, as far as practicable to minimize the fugitive dust arising from unloading/loading.	During construction	V
	All stockpiles of excavated materials or spoil of more than 50m³ shall be enclosed, covered or dampened during dry or windy conditions.		@
	Effective water sprays shall be used to control potential dust emission sources such as unpaved haul roads and active construction areas.		@
	All spraying of materials and surfaces shall avoid excessive water usage.		V
	Vehicles that have the potential to create dust while transporting materials shall be covered, with the cover properly secured and extended over the edges of the side and tail boards.		V
	Materials shall be dampened, if necessary, before transportation.		V
	Travelling speeds shall be controlled to reduce traffic induced dust dispersion and re-suspension within the site from the operating haul trucks.		V
	Vehicle washing facilities shall be provided to minimize the quantity of material deposited on public roads.		V

Noise - Schedule of Recommended Mitigation Measures

Impact	Mitigation Measures	Timing	Implementation Status
Noise during construction	Use of silenced plant or plant equipped with mufflers or dampers in substitute of ordinary plant.	During construction	V
	Reduce the number of equipment and their percentage on-time.		V
	3.5 m and 5.5 m high temporary noise barrier at culvert construction work area (Figure 2a of the Environmental Permit).		V*
	3 m high temporary noise barrier along the northern edge of Bridge 12 at ground level (Figure 2b of the Environmental Permit).		V*
	2 m high temporary noise barrier along the northern edge of Bridge 12 at bridge level (Figure 2b of the Environmental Permit).		V*
	2.5 m high temporary noise barrier along Tai Wo Service Road West (Figure 2c of the Environmental Permit).		V*
	3.5m and 7m high temporary noise barrier along Tai Wo Services Road West near Tai Hang (Figure 2c of the Environmental Permit).		V*
	7 m high temporary noise barrier along Tai Wo Service Road West near Tai Wo Footbridge work area (Figure 2d of the Environmental Permit).		V*
	7 m high temporary noise barrier near Kiu Tau Footbridge work area (Figure 2d of the Environmental Permit).		V*
	2.5 m high temporary noise barrier near river diversion work area (Figure 2e of the Environmental Permit).		V*

^{*} Permanent noise barriers have been erected.

Water Quality – Schedule of Recommended Mitigation Measures

Impact	Mitigation Measures	Timing	Implementation Status
Water quality during construction	 Demolition and reconstruction of bridges Prevent off-site migration through use of sheet piles. Minimise duration of works as far as practical. All sewer and drainage connections should be sealed to prevent debris, soil, sand, etc, from entering public sewers/drains. Site surface runoff should be settled to remove sand/silt before it is discharged into the existing storm drains. Road Widening Works, Earthworks and Culvert Extension Works Wastewater generated from any concrete batching washdown of equipment or similar activities should be discharged into foul sewers, after the removal of settable solids, and pH adjustment as necessary. All sewage discharges from the study area should meet the TM standards and approval from EPD through the licensing process is required. Sand traps, oil interceptors and other pollution prevention installations should be provided, properly cleaned and maintained. Runoff from exposed working areas, unfinished slopes and from unlined temporary channels should be directed to stilling basins and/or silt traps before discharging to the drainage outfalls. Regular inspections of stilling basins and/or silt traps are required to ensure that sediment is not conveyed into the existing drainage system. Open stockpiles should be covered with a tarpaulin cover. During the wet season, any exposed top soils should be covered with a tarpaulin, shotcreted or hydroseeded. Sand and silt from wash-water from vehicle washing should be settled out before discharging into storm drains. Fuels should be stored in bunded areas such that spillage can be easily collected. 	During construction	V

Waste - Schedule of Recommended Mitigation Measures

Impact	Mitigation Measures	Timing	Implementation Status
Waste management during construction	 General Waste Transport of wastes off site as soon as possible. Maintenance of accurate waste records. Minimisation of waste generation for disposal (via reduction/recycling/re-use). No on-site burning will be permitted. Use of re-useable metal hoardings/signboards. 	During construction	@
	Vegetation from site clearance - Segregation of materials to facilitate disposal Mulching to reduce bulk and where possible review opportunities for the possible beneficial use within landscaping areas.		V
	Demolition Wastes - Segregation of materials to facilitate disposal Appropriate stockpile management.		V
	 Excavated Materials Segregation of materials to facilitate disposal / reuse. Appropriate stockpile management. Re-use of excavated material on or off site (where possible). Special handling and disposal procedures in the event that contaminated materials are excavated. 		V
	 Construction Wastes Segregation of materials to facilitate recycling/reuse (within designated area in appropriate containers/stockpiles). Appropriate stockpile management. Planning to reduce over ordering and waste generation. Recycling and re-use of materials where possible (e.g. metal, wood from formwork) For material which cannot be re-used/recycled, collection should be carried out by an approved waste contractor for landfill disposal. 		V
	 Bentonite Slurries Bentonite slurries should be reused as far as possible. Disposal in accordance with Practice Note For Professional Persons ProPECC PN 1/94. 		#

 Chemical Wastes Storage within locked, covered and bunded area. The storage area shall not be located adjacent to sensitive receivers e.g. drains. Minimise waste production and recycle oils/solvents where possible. A spill response procedure shall be in place and absorption material available for minor spillages. Use appropriate and labelled containers. Educate site workers on site cleanliness/waste management procedures. If chemical wastes are to be generated, the contractor must register with EPD as a chemical waste producer. The chemical wastes shall be collected by a licensed chemical waste collector. 	@
Municipal Wastes Waste shall be stored within a temporary refuse collection facility, in appropriate containers prior to collection and disposal. Regular, daily collections are required by an approved waste collector.	V

Ecology – Schedule of Recommended Mitigation Measures

Impact	Mitigation Measures	Timing	Implementation Status
Ecology during construction	 Accurate Delineation of Works Area Boundaries of proposed works areas shall be clearly identified and separated from external areas by a physical barrier to prevent encroachment of adjacent habitats. Individual trees which fall within the works areas but which work plans do not require removal are to be retained and fenced off to maximize protection. 	During construction	V
	Vegetation Clearance No fires shall be lit within the works area for the purpose of burning cleared vegetation. The Contractor shall give consideration to mulching the cleared vegetation for recycling within the works area / adjacent land.		V
	 Dust generation There are a number of measures which shall be taken as specified in the Air Pollution Control (Construction Dust) Regulation on 'Dust Control Requirements, including the following key measures to be applied during construction: Vehicle washing facilities to be provided at every discernible or designated vehicle exit point; All temporary site access roads shall be sprayed with water to suppress dust as necessary; All dusty materials should be sprayed with water immediately prior to any handling; and All debris should be covered entirely by impervious sheeting or stored in a sheltered debris collection area. 		@
	Surface Run-off In general, mitigation measures shall be in accordance with ProPECC PN1/94 on 'Construction Site Drainage'. Key measures include: - Bund and cover stock piles to avoid run-off; - Channel any run-off through a system of oil, grease and sediment / silt traps and reuse water on site where ever practical; - All vehicle maintenance to be undertaken within a bunded area; and - Maximise vegetation retention on-site to maximise absorption (minimise transport).		V

Landscape and Visual Impact - Schedule of Recommended Mitigation Measures

Impact	Mitigation Measures	Timing	Responsibility
Landscape & Visual during construction	Preservation of Existing Vegetation Trees identified for retention within the project limit would be protected during the works; The tree transplanting and planting works shall be implemented by approved Landscape Contractors.	During construction	V
	Temporary Works Areas Where feasible the works areas would be screened using hoarding and existing vegetation would be retained where possible to reduce the landscape and visual impacts arising from the construction activity. The landscape of these works areas would be restored following the completion of the construction phase.		V
	Hoarding A hoarding would be erected where practicable in the most visually sensitive locations to screen the temporary construction works from the local VSRs.		V
	Top Soils The works will result in disturbance to extensive areas of topsoil. Topsoil worthy of retention should be stockpiled for use following completion of the civil engineering works. It should either be temporarily vegetated with hydroseeded grass or turned over on a regular basis.		#
	Protection of Important Landscape Features - Important features such as temples, Island House and kilns within the study area, although remote from the proposed works retained and adequately protected.		#

Legend:

V = implemented;

x = not implemented;

@ = partially implemented;

+ = recommended and immediately implemented during the site inspection by the Contractor;

N/A = not applicable - No such work was undertaken or no such material was used on site;

= to be implemented.

APPENDIX D SUMMARY OF ACTION AND LIMIT LEVELS

Appendix D - Summary of Action and Limit Levels

Table 1 – Action and Limit Levels for 1-hour TSP

Location	Action Level	Limit Level	
AM2	317.8 μg/m3	500 μg/m3	

Table 2 - Action and Limit Levels for 24-hour TSP

Location	Action Level	Limit Level	
AM2	200.7 μg/m3	260 μg/m3	

Table 3 – Action and Limit Levels for Construction Noise (0700-1900 hrs of normal weekdays)

Location	Action Level	Limit Level
M2	When one documented	75 dB(A)
	complaint, related to 0700 -	
	1900 hours on normal	
M3*	weekdays, is received	65/70 dB(A)
	from any one of the sensitive	
	receivers	

^{*}Daytime noise Limit Level of 70 dB(A) applies to education institutions, while 65dB(A) applies during school examination period

APPENDIX E
CALIBRATION CERTIFICATES OF
MONITORING EQUIPMENTS



RECALIBRATION
DUE DATE:

December 31, 2019

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 31, 2018

Rootsmeter S/N: 438320

Ta: 293

°K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 0843

Pa: 741.7 mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3830	3.2	2.00
2	3	4	1	0.9820	6.4	4.00
3	5	6	1	0.8780	7.9	5.00
4	7	8	1	0.8360	8.7	5.50
5	9	10	1	0.6890	12.7	8.00

	Data Tabulation					
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)	
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)	
0.9883	0.7146	1.4089	0.9957	0.7199	0.8889	
0.9840	1.0020	1.9925	0.9914	1.0095	1.2571	
0.9820	1.1184	2.2277	0.9893	1.1268	1.4054	
0.9809	1.1733	2.3365	0.9883	1.1821	1.4740	
0.9756	1.4159	2.8179	0.9829	1.4265	1.7777	
	m=	2.00999		m=	1.25862	
QSTD[b=	-0.02384	QA	b=	-0.01504	
	r=	0.99998	~.	r=	0.99998	

	Calculation	s		
	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)	
Qstd=	Qstd= Vstd/∆Time		Qa= Va/ΔTime	
	For subsequent flow rate	e calculatio	ns:	
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$	

Standard Conditions
298.15 °K
760 mm Hg
Key
manometer reading (in H2O)
er manometer reading (mm Hg)
olute temperature (°K)
ometric pressure (mm Hg)

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Total Suspended Particulates (TSP) Sampler Field Calibration Report

Station	Fanling Governm	ent Secondary	School (AM2)		Operator:	Choi Wir	ng Ho
Date:	10-Jul-19	_	Next Due Date:			10-Sep-19	
Model No:	TE-5170					O.T.S	
Equipment No.:	A-001-74T				Expiration Date:	6-Jun-	-20
			Ambient C	Condition			
Tempera	ture, Ta	303.0	Kelvin	Pressu	ıre, Pa	751.0	mmHg
	-4-	929		-44			
	T T	0 0.55	rifice Transfer Sta				
Equipme		988	Slope, mc	1.98	356	Intercept, bc	-0.02592
Last Calibra		6-Jun-19	r	nc x Qstd + bc =	= [H x (Pa/760)	$(298/Ta)^{1/2}$	
Next Calibr	ation Date:	6-Jun-20					
		-					
	Ι	Т	Calibration of			<u> </u>	
Calibration	Н	[H x (Pa/7)	60) x (298/Ta)] ^{1/2}	Qstd (m³/min)	W	[ΔW x (Pa/760) z	
Point	in. of water		(======================================	X - axis	in. of oil	Y-ax	is
1	7.1		2.63	1.34	5.5	2.31	
2	5.6		2.33	1.19	4.4	2.07	
3	4.5		2.09	1.07	3.4	1.82	
4	3.2		1.76	0.90	2.5	1.56	
5	2.5		1.56	0.80	1.9	1.36	
By Linear Regr	ession of Y on X	K					
Slope, $mw =$	1.7545	_		Intercept, bw =		-0.035	58
Correlation C	oefficient* =	0.	.9990				
			Set Point Ca				
			$td = 1.21 \text{ m}^3/\text{min} (4)$	3 CFM)			
From the Regres	sion Equation, th	ie "Y" value a	ecording to				
		m x ($Qstd + b = [\mathbf{W} \ x \ (\mathbf{P}$	Pa/760) x (298/T	a)] ^{1/2}		
Therefore, S	Set Point W = (n	$(a \times Qstd + b)^2$	² x (760 / Pa) x (T	(a / 298) =	4.	48	
*If Correlation C	officient < 0.00	10. ahaals and a	eggalikusta again				
11 CONTRIBUION C	ocincient ~ 0.99	o, check and i	ecanorate agam.				
Remarks:							
· ·····································		1					
QC Reviewer:	WS UH	42	Signature:	P1		Date: 10/07	119

Total Suspended Particulates (TSP) Sampler Field Calibration Report

Station	Fanling Governm	ent Secondary	School (AM2)		Operator:	Choi Wir	ng Ho
Date:	10-Sep-19				Next Due Date:	10-Nov	<i>y</i> -19
Model No:	TE-5170	_			Verified Against:	O.T.S	988
Equipment No.:	A-001-74T				Expiration Date:		
					30		
			Ambient C	Condition			
Temperat	ture, Ta	306.0	Kelvin	Pressu	re, Pa	755.4	mmHg
900 (10 miles)			(1)				
		Oı	rifice Transfer Sta	ndard Informat	tion		
Equipme	nt No.:	988	Slope, mc	1.98	356	Intercept, bc	-0.02592
Last Calibra	tion Date:	6-Jun-19	n	nc x Qstd + bc =	= [H v (Pa/760)	v (208/Ta)1 ^{1/2}	
Next Calibra	ation Date:	6-Jun-20	11	iic x Qstu + bc -	- [II x (I a//00)	x (290/1a)]	
							70
			Calibration of				
Calibration	Н		sov (200 / 201/2	Qstd	W	[ΔW x (Pa/760) :	x (298/Ta)] ^{1/2}
Point	in. of water	[H x (Pa/7)	60) x (298/Ta)] ^{1/2}	(m³/min)	in. of oil	Y-ax	
1	7.0		2.60	X - axis	5.5	2.31	
2	5.6		2.33	1.19	4.4	T	
3	4.5		2.09	1.19	3.3	2.06	
4	3.4						
5	2.6		1.81	0.93	2.5	1.56	
By Linear Regre		<u> </u>	1.39	0.61	1.0	1.32	
Slope, mw =		x	1	Intercept, bw =		-0.223	20
Correlation Co		-	.9992	intercept, bw –		-0.22.	33
Correlation	_						
	(0.18.78)	*	7.37.0	- 1 d d d d	- 0	3.00	10.155
			Set Point Ca	alculation			
From the TSP Fig	eld Calibration (Curve, take Qs	$std = 1.21 \text{ m}^3/\text{min } (4)$	13 CFM)			
From the Regress	sion Equation, th	ne "Y" value a	ccording to				
197					1/2		
		m x	$\mathbf{Qstd} + \mathbf{b} = [\mathbf{W} \ \mathbf{x} \ (\mathbf{F}$	Pa/760) x (298/T	(a)] ^{1/2}		
Therefore S	set Point W = (r	n x Ostd + h)	² x (760 / Pa) x (T	Ta / 298) =	4	.48	
Therefore, S	cerome w (1	ii x Qsia · b)	x(700714)x(1			.40	
*If Correlation C	oefficient < 0.99	00, check and	recalibrate again.	200,100		-	
Remarks:							
-	0000		110		419		
		(1)	9	71		* /	10
QC Reviewer:	WS CH	AN	Signature:	4		Date: 10/69	117

EQUIPMENT CALIBRATION RECORD

Type: Manu	facturer/Brand:			_	Laser Du SIBATA	ıst Moni	tor			
Model	No.:				LD-3					
	ment No.:				A.005.07	a				
Sensit	tivity Adjustment	Scale Se	tting:	_	557 CPI	И				
Opera	itor:			_	Mike She	k (MSKN	1)			
Standa	rd Equipment									
Equip	ment:	Pu	nnroc	ht & Da	tashnick	TEOM®				
Venue					ing Seco		shool)			
Model				400AB	ing Seco	nuary Sc	511001)			
Serial			ntrol:		DAB21989	00803	10.14			
Serial	NO.		nsor:		00C14365		K _o : 12	2500		
Last C	Calibration Date*:		//ay 20		00 14300	09003	No. <u>12</u>	2500		
*Remar	ks: Recommend	led interva	al for I	hardwar	e calibrat	tion is 1 y	/ear			
Calibra	tion Result									
	ivity Adjustment ivity Adjustment						557 557	CPI		
Hour	Date		Time		Amb		Concentration	n ¹	Total	Count/
	(dd-mm-yy)				Cond		(mg/m ³)		Count ²	Minute ³
					Temp (°C)	R.H.	Y-axis			X-axis
1	04-05-19	09:15	_	10:15	23.7	(%) 81	0.04765		1914	31.90
2	04-05-19	10:15		11:15	23.7	82	0.05036		2025	33.75
3	04-05-19	11:15		12:15	23.8	82	0.05251		2103	35.05
4	04-05-19	12:15	-	13:15	23.8	82	0.05587		2231	37.18
Note:	 Monitoring of 2. Total Count Count/minut 	was logg	ed by	Laser [Dust Mon	tor	shnick TEOM®)		
By Linea	ar Regression of	Y or X								
Slope	(K-factor):		0.0	0015						
Correl	ation coefficient:		0.9	9977						
Validit	y of Calibration F	Record:	_41	May 202	20					
Remark	s:									
	(80.00					[1]	¥765		24	
OC Re	viewer. YW F	una		Signat	ure.	/		Data:	06 May	2010

EQUIPMENT CALIBRATION RECORD

Model Equip	facturer/Brand:	Scale Set	ting:	Laser Do SIBATA LD-3 A.005.09 797 CPI)a	itor		
Opera	ator:		-	Mike She	ek (MSKI	M)		
Standa	rd Equipment	57						
	e: l No.:	Cyb Seri Con Sen 2 M	sor: 12 lay 2019	Ying Seco 0AB21989 00C14369	99803 59803	K _o : <u>12500</u>		
Calibra	tion Result							
	tivity Adjustment tivity Adjustment					797 CP		
Hour	Date (dd-mm-yy)	Т	ime	1.00	dition	Concentration ¹ (mg/m³) Y-axis	Total Count ²	Count/ Minute ³ X-axis
1 2	04-05-19 04-05-19	09:45 10:45	- 10:45 - 11:45	23.7	(%) 81 82	0.04813 0.05032	1925 2022	32.08 33.70
3	04-05-19 04-05-19	11:45 12:45	- 12:45 - 13:45	23.8	82 82	0.05264	2118	35.30
Note:	Monitoring of 2. Total Count 3. Count/minut	lata was m was logge e was cald	neasured by ed by Laser	Rupprecl Dust Mon	nt & Pata itor	O.05515 ashnick TEOM®	2220	37.00
Slope	ar Regression of (K-factor): ation coefficient:	Y or X	0.0015 0.9976					
Validit	y of Calibration F	Record:	4 May 20	20				
Remark	s:							
OC Re	eviewer: YW F	- una	Signa	ture:	W	Date	o: 06 May	2010



香港黄竹坑道37號利達中心12樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.:

19CA0327 01-02

Page:

to:

Item tested

Description:

Acoustical Calibrator (Class 1)

Manufacturer:

B&K

Type/Model No .: Serial/Equipment No.: 4231

3006428 / N004.03

Adaptors used:

Item submitted by

Curstomer:

AECOM ASIA CO LIMITED

Address of Customer:

Request No.: Date of receipt:

27-Mar-2019

(N.004.03)

Date of test:

27-Mar-2019

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable t
Lab standard microphone	B&K 4180	2341427	20-Apr-2019	SCL
Preamplifier	B&K 2673	2743150	27-Apr-2019	CEPREI
Measuring amplifier	B&K 2610	2346941	08-May-2019	CEPREI
Signal generator	DS 360	33873	24-Apr-2019	CEPREI
Digital multi-meter	34401A	US36087050	23-Apr-2019	CEPREI
Audio analyzer	8903B	GB41300350	23-Apr-2019	CEPREI
Universal counter	53132A	MY40003662	24-Apr-2019	CEPREI

Ambient conditions

Temperature:

22 ± 1 °C

Relative humidity: Air pressure:

55 ± 10 % 1005 ± 5 hPa

Test specifications

- 1, The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- 2, The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- 3. The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on page 2 of this certificate

Feng Jung

Approved Signatory:

Date:

29-Mar-2019

Company Chop:

Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

© Soils & Materials Engineering Co., Ltd.

Form No.CARP156-1/Issue 1/Rev.D/01/03/2007



香港黄竹坑道37號利達中心12樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.:

19CA0327 01-02

Page:

2

1, Measured Sound Pressure Level

> The output Sound Pressure Level in the calibrator head was measured at the setting and frequency shown using a calibrated laboratory standard microphone and insert voltage technique. The results are given in below with the estimated uncertainties

(Output level in	aB re 20 µPa)
Estimated	Evpanded

Frequency	Output Sound Pressure	Measured Output	Estimated Expanded
Shown	Level Setting	Sound Pressure Level	Uncertainty
Hz	dB	dB	dB
1000	94.00	94.23	0.10

2. Sound Pressure Level Stability - Short Term Fluctuations

The Short Term Fluctuations was determined by measuring the maximum and minimum of the fast weighted DC output of the B&K 2610 measuring amplifier over a 20 second time interval as required in the standard. The Short Term Fluctuation was found to be:

At 1000 Hz

STF = 0.014 dB

Estimated expanded uncertainty

0 005 dB

3, **Actual Output Frequency**

The determination of actual output frequency was made using a B&K 4180 microphone together with a B&K 2673 preamplifier connected to a B&K 2610 measuring amplifier. The AC output of the B&K 2610 was taken to an universal counter which was used to determine the frequency averaged over 20 second of operation as required by the standard. The actual output frequency at 1 KHz was:

At 1000 Hz

Actual Frequency = 1000.0 Hz

Estimated expanded uncertainty

0.1 Hz

Coverage factor k = 2.2

4, Total Noise and Distortion

For the Total Noise and Distortion measurement, the unfiltered AC output of the B&K 2610 measuring amplifier was connected to an Agilent Type 8903 B distortion analyser. The TND result at 1 KHz was:

At 1000 Hz

TND = 0.3 %

Estimated expanded uncertainty

0.7 %

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

End

Calibrated by:

Fung Chi Yip

Date: 27-Mar-2019

Date:

29-Mar-2019

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.

C Soils & Materials Engineering Co., Ltd.

Form No.CARP156-2/Issue 1/Rev.C/01/05/2005



香港 黄竹坑 道 3 7 號 利 達 中 心 1 2 樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.:

19CA0327 01-01

Page

of

2

Item tested

Description: Manufacturer: Sound Level Meter (Type 1) B & K Microphone B & K 4188

Type/Model No.: Serial/Equipment No.: 2238 2285692

2250455

Expiry Date:

Adaptors used:

_

_

Item submitted by

Customer Name:

AECOM ASIA CO., LTD.

Address of Customer:

Request No.:

27-Mar-2019

(N.009.04)

Date of test:

Date of receipt:

28-Mar-2019

Reference equipment used in the calibration

Description:

Signal generator

Multi function sound calibrator Signal generator

B&K 4226 DS 360 DS 360

Model:

Serial No.

2288444 23-Aug-2019 33873 24-Apr-2019 61227 26-Dec-2019 Traceable to:

CIGISMEC CEPREI CEPREI

Ambient conditions

Temperature:

22 ± 1 °C 55 ± 10 %

1005 ± 5 hPa

Relative humidity: Air pressure:

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- 2, The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responsess of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets

Feng Jung

Approved Signatory:

Date:

29-Mar-2019

Company Chop:

家ENGINEGA 综合試驗 COM 有限公司

Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

© Soils & Materials Engineering Co., Ltd

Form No CARP152-1/Issue 1/Rev.C/01/02/2007



香港黄竹坑道37號利達中心12樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. Website: www.cigismec.com E-mail: smec@cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.:

19CA0327 01-01

1, **Electrical Tests**

> The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

			Expanded	Coverage
Test:	Subtest:	Status:	Uncertanity (dB)	Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	1.0	2.1
	Lin	Pass	2.0	2.2
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
Frequency weightings	A	Pass	0.3	
	C	Pass	0.3	
	Lin	Pass	0.3	
Time weightings	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/103 at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/104 at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertanity (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

4, Remark: This calibration certificate supersedes the last certificate 18CA0406 02-01

Calibrated by:

Checked by:

Fung Chi Yip

Date:

Fong Chun Wai 28-Mar-2019

29-Mar-2019

The standard(s) and equipment used in the calibration are traceable to national ∮r international recognised standards and are calibrated on a schedule to maintain the required accuracy level.

End

© Soils & Materials Engineering Co., Ltd.

Form No.CARP152-2/Issue 1/Rev.C/01/02/2007



港 黄 竹 坑 道 3 7 號 利 達 中 心 1 2 樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com

Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

Certificate No.:

19CA0912 01

Page

Microphone

of

2

Item tested

Description: Manufacturer: Sound Level Meter (Type 1)

B&K 2238

B&K 4188 2791211

Type/Model No.: Serial/Equipment No.: Adaptors used:

2800927

Item submitted by

Customer Name:

AECOM ASIA CO., LTD.

Address of Customer:

Request No.

Date of receipt:

12-Sep-2019

Date of test:

16-Sep-2019

Reference equipment used in the calibration

Description:

Signal generator

Model:

DS 360

Serial No.

Expiry Date:

Traceable to:

Multi function sound calibrator

B&K 4226

2288444

61227

23-Aug-2020

CIGISMEC

26-Dec-2019

CEPREI

Ambient conditions

Temperature:

Relative humidity:

21 ± 1 °C 55 ± 10 %

Air pressure:

1000 ± 5 hPa

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- 2, The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of +20%
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference 3, between the free-field and pressure responsess of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Feng Jungi

Actual Measurement data are documented on worksheets

Approved Signatory:

Date:

16-Sep-2019

Company Chop:

The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument.

Soils & Materials Engineering Co., Ltd.

Form No.CARP152-1/Issue 1/Rev.C/01/02/2007



香港 黄 竹 坑 道 3 7 號 利 達 中 心 1 2 樓 12/F., Leader Centre, 37 Wong Chuk Hang Road, Aberdeen, Hong Kong. E-mail: smec@cigismec.com Website: www.cigismec.com Tel: (852) 2873 6860 Fax: (852) 2555 7533



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.:

19CA0912 01

Page

01

2

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertanity (dB)	Coverage Factor
	oubcot.	Otatas.	Gilocriainty (GB)	1 40101
Self-generated noise	A	Pass	0.3	
•	C	Pass	1.0	2.1
	Lin	Pass	2.0	2.2
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
• • • • • • • • • • • • • • • • • • • •	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
Frequency weightings	A	Pass	0.3	
	C	Pass	0.3	
	Lin	Pass	0.3	
Time weightings	Single Burst Fast	Pass	0.3	
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
R.M.S. accuracy	Crest factor of 3	Pass	0.3	
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/103 at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/104 at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.

Test:	Subtest	Status	Expanded Uncertanity (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

Calibrated by:

Date: Fung Chi Yip 16-Sep-2019

End

Checked by

Date: 16

16-Sep-2019

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.

© Soils & Materials Engineering Co., Ltd.

Form No.CARP152-2/Issue 1/Rev.C/01/02/2007

APPENDIX F EM&A MONITORING SCHEDULES

Contract No. HY/2012/06 Widening of Fanling Highway – Tai Hang to Wo Hop Shek Interchange Impact Monitoring and Audit Schedule for September 2019

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
1-Sep	2-Sep	3-Sep	4-Sep	5-Sep	6-Sep	7-Sep
			1-hr TSP			
			24-hr TSP			
			Noise			
		Site Audit				
8-Sep	9-Sep	10-Sep	11-Sep	12-Sep	13-Sep	14-Sep
		1-hr TSP				
		24-hr TSP				
		Noise				
		Site Audit				
15-Sep	16-Sep	17-Sep	18-Sep	19-Sep	20-Sep	21-Sep
	1-hr TSP					1-hr TSP
	24-hr TSP					24-hr TSP
	Noise					
				Site Audit		
22-Sep	23-Sep	24-Sep	25-Sep	26-Sep		28-Sep
					1-hr TSP	
					24-hr TSP	
					Noise	
		Site Audit				
29-Sep	30-Sep					
	Site Audit					

Contract No. HY/2012/06 Widening of Fanling Highway – Tai Hang to Wo Hop Shek Interchange Tentative Impact Monitoring and Audit Schedule for October 2019

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Oct	2-Oct	3-Oct	4-Oct	5-Oct
				1-hr TSP		
				24-hr TSP		
				Noise		
6-Oct	7-Oct	8-Oct	9-Oct	10-Oct	11-Oct	12-Oct
			1-hr TSP			
			24-hr TSP			
			Noise			
		Site Audit				
13-Oct	14-Oct	15-Oct	16-Oct	17-Oct	18-Oct	19-Oct
		1-hr TSP				
		24-hr TSP				
		Noise				
		Site Audit				
20-Oct	21-Oct	22-Oct	23-Oct	24-Oct	25-Oct	26-Oct
	1-hr TSP					1-hr TSP
	24-hr TSP					24-hr TSP
	Noise					
				Site Audit		
27-Oct	28-Oct	29-Oct	30-Oct	31-Oct		
		Site Audit				

The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc)

APPENDIX G
IMPACT AIR QUALITY MONITORING
RESULTS AND THEIR GRAPHICAL
PRESENTATION

Appendix G Impact Air Quality Monitoring Results


24-hour TSP Monitoring Results at Station AM2 (Fanling Government Secondary School)

Date	Weather	Air		Flow Rate	(m³/min.)	Av. flow	Total vol.	Filter W	/eight (g)	Particulate	Elapse	Time	Sampling	Conc.	Action Level	Limit Level
	ConditionTe	emp. (°C)Pressure(hPa)	Initial	Final	(m³/min)	(m³)	Initial	Final	weight(g)	Initial	Final	Time(hrs.)	(µg/m³)	(µg/m ³)	(µg/m ³)
4-Sep-19	Cloudy	26.8	1004.0	1.324	1.324	1.324	1906.6	2.6846	2.7104	0.0258	12306.02	12330.02	24.00	13.5	200.7	260
10-Sep-19	Sunny	30.1	1008.9	1.324	1.324	1.324	1906.6	2.7177	2.7471	0.0294	12330.02	12354.02	24.00	15.4	200.7	260
16-Sep-19	Sunny	29.3	1007.7	1.324	1.324	1.324	1906.6	2.7106	2.7602	0.0496	12354.02	12378.02	24.00	26.0	200.7	260
21-Sep-19	Sunny	29.2	1008.0	1.324	1.324	1.324	1906.6	2.6591	2.7540	0.0949	12378.02	12402.02	24.00	49.8	200.7	260
27-Sep-19	Sunny	27.6	1016.6	1.324	1.324	1.324	1906.6	2.7191	2.7924	0.0733	12402.02	12426.02	24.00	38.4	200.7	260

 Average
 28.6

 Min
 13.5

 Max
 49.8

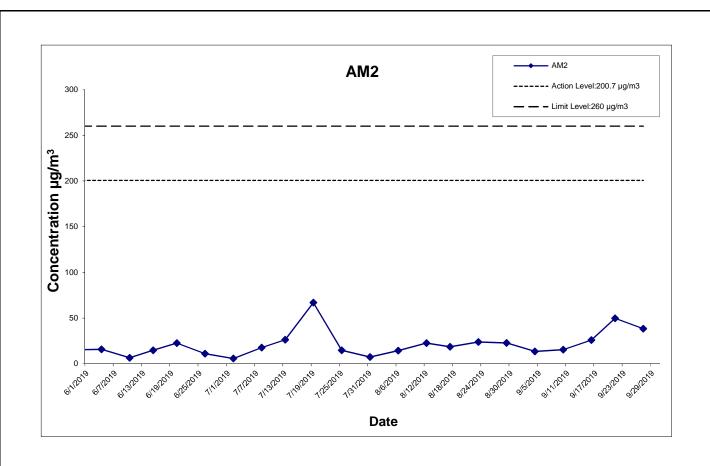

the Creation has been recovered for the use of ASTANIC client It may not be used modified recordured or collect upon by third natries covered as acrossed by ASTANIC was required by law ASTANIC across consciously and desires any Exhibits whetevour to now north that uses or ratios on this decision without ASTANIC coveres written record

CONTRACT NO. HY/2012/06
WIDENING OF FANLING HIGHWAY
- TAI HANG TO WO HOP SHEK INTERCHANGE




Project No.: 60307376 Date: Oct-19 Appendix G

Appendix G Impact Air Quality Monitoring Results

1-hour TSP Monitoring Results at Station AM2 (Fanling Government Secondary School)

	Start	1st Hour	2nd Hour	3rd Hour
Doto	Time (hh:mm)	Conc. (µg/m³)	Conc. (µg/m³)	Conc. (µg/m³)
Date			(10)	0
4-Sep-19	13:05	76.5	76.8	76.1
10-Sep-19	13:15	60.2	59.2	60.9
16-Sep-19	10:12	61.2	60.5	60.2
21-Sep-19	10:35	67.5	70.2	69.6
27-Sep-19	13:15	61.1	62.7	60.2
			Average	65.5
			Min	59.2
			Max	76.8

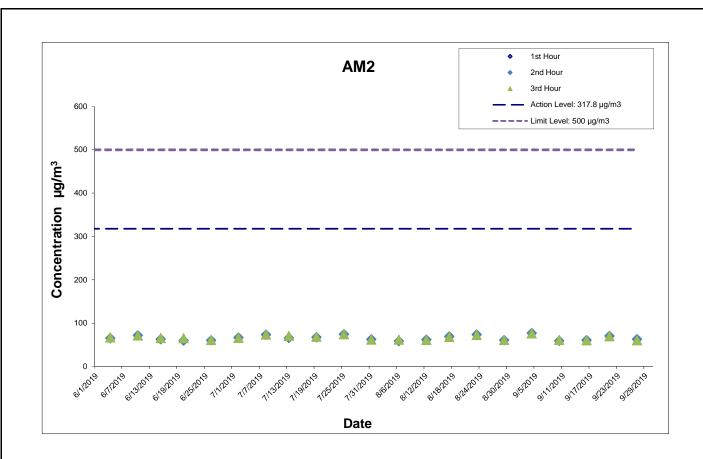

This Drawing has been prepared for the use of AECOM's client. It may not be used, modified, reproduced or relied upon by third parties, except as agreed by AECOM or as required by law. AECOM accepts no responsibility, and denies any liability whatsover, to any party that uses or relies on this drawing without AECOM's express written consent.

CONTRACT NO. HY/2012/06
WIDENING OF FANLING HIGHWAY
- TAI HANG TO WO HOP SHEK INTERCHANGE



Project No.: 60307376 Date: Oct-19 Appendix G

APPENDIX H
METEOROLOGICAL DATA FOR THE
REPORTING MONTH

10/8/2019 **Daily Extract**





SEARCH Enter search keyword(s)

SITE MAP

Home

About us

What's new

Daily Extract of Meteorological Observations, September 2019

Year 2019 ▼ Month 9 ▼ Go

HKO Updates			Yea	r 2019	▼ Month	9 🔻	Go					
Our Services		Hong Kong Observatory								King's Park Waglan Islar		sland^
Visitors Figures			Air Temperature		ature	Mean		Mean				
Press releases	Day	Mean	Absolute		Absolute	Dew	Mean Relative	Amount	Total	Total Bright	Prevailing Wind	Mean Wind
Weather Note (Chinese)		Pressure (hPa)	Daily	Mean (deg.	Daily	Point (deg.	Humidity	of Cloud	Rainfall (mm)	Sunshine	Direction	Speed
Weather Warning		(111 4)	Max (deg. C)	(c)	Min (deg. C)	C)	(%)	(%)	()	(hours)	(degrees)	(km/h)
Local Weather	01	1006.5	31.0	28.2	26.2	24.7	82	85	8.5	4.7	***	***
Observations	02	1007.0	28.1	26.9	25.2	25.2	90	88	38.4	0.1	***	***
Weather Forecast	03	1005.6	30.9	28.4	26.2	24.6	80	85	12.9	5.9	***	***
Weather Monitoring	04	1004.0	28.3	26.8	25.5	25.1	91	89	62.2	1.4	***	***
Imagery	05	1003.1	29.3	27.2	25.4	25.1	88	89	31.8	4.1	***	***
Computer Forecast	06	1002.5	32.4	28.9	26.8	24.9	79	55	0.2	9.5	***	***
Products	07	1003.6	33.3	29.8	27.5	25.6	79	25	0.4	8.2	***	***
MyObservatory	08	1004.7	33.0	30.0	28.0	26.2	80	31	0.4	9.0	***	***
Earth Weather	09	1005.8	33.3	30.0	28.3	25.7	78	47	0.0	4.1	***	***
Met on Map	10	1008.9	33.3	30.1	28.2	25.2	76	27	0.0	10.5	***	***
Tropical Cyclones	11	1011.3	33.3	30.2	28.4	24.6	73	38	Trace	10.0	***	***
Aviation Weather	12	1009.9	33.5	30.3	28.3	24.8	73	44	0.0	9.8	***	***
Services	13	1008.4	33.0	30.1	28.7	25.6	77	64	Trace	6.1	***	***
Marine Meteorological	14	1008.4	32.3	29.8	28.4	25.5	78	69	Trace	4.8	***	***
Services	15	1008.2	32.2	29.2	25.9	24.4	76	51	11.0	5.5	***	***
Weather Information for	16	1007.7	32.3	29.3	26.3	24.5	76	73	4.3	7.4	***	***
Sports	17	1009.0	31.8	29.2	27.9	24.5	76	80	2.1	4.8	***	***
Weather Information for	18	1010.9	32.0	28.8	25.8	24.7	79	79	18.0	5.2	***	***
Communities	19	1011.3	32.4	28.0	24.9	22.7	74	54	8.7	10.3	***	***
China Weather	20	1008.7	32.6	29.0	26.2	17.5	52	9	0.0	11.0	***	***
World Weather	21	1008.0	32.5	29.2	26.5	14.8	42	2	0.0	11.1	***	***
Climatological Information	22	1012.2	31.3	28.3	25.9	13.1	40	7	0.0	11.2	***	***
Services	23	1016.2	30.7	27.7	25.4	18.4	57	41	0.0	8.0	***	***
> Climate Watch	24	1017.5	30.3	27.5	26.3	21.5	70	59	0.0	7.0	***	***
> Climate Statistics	25	1017.3	30.8	27.3	25.7	21.4	71	32	Trace	5.9	***	***
> Climate Prediction	26	1017.2	30.8	27.5	25.5	21.6	71	43	0.0	7.6	***	***
> Climate Knowledge	27	1016.6	30.6	27.6	25.7	21.9	72	46	Trace	5.7	***	***
> Need More	28	1015.0	32.2	28.2	25.9	22.2	71	33	0.0	8.6	***	***
Information?	29	1012.8	31.7	28.7	26.6	23.7	75	33	0.0	8.8	***	***
> Global Climate	30	1008.8	33.4	30.1	27.2	22.0	64	21	0.0	10.0	***	***
Services	Mean/Total	1009.6	31.8	28.7	26.6	23.1	73	50	198.9	216.3	***	***
> Other Useful Links	Normal [§]	1008.9	30.1	27.7	25.8	23.4	78	66	327.6	172.3	090	22.6
Climate Forecast		•	•									

Climate Forecast

Climate Change

El Nino and La Nina

Earthquakes and

Tsunamis

Astronomy, Space

Weather and Geomagnetism *** unavailable

^ Information of wind direction and wind speed for Waglan Island are based on automatic weather station data since January 1989

Trace means rainfall less than 0.05 mm

§ 1981-2010 Climatological Normal, unless otherwise specified

APPENDIX I
IMPACT DAYTIME CONSTRUCTION NOISE
MONITORING RESULTS AND THEIR
GRAPHICAL PRESENTATION

Appendix I Impact Daytime Construction Noise Monitoring Results


Location : M2 (West Tai Wo - Free Field)Day time 07:00-19:00 hrs Normal Weekdays Impact Noise Monitoring Results


	Meas	ured Noise Le	Limit Level,	Exceedance		
Date	Start Time	Leq*	L10*	L90*	dB(A)	(Y/N)
4-Sep-19	14:15	67.1	69.0	65.5	75	N
10-Sep-19	14:00	65.8	67.0	63.0	75	N
16-Sep-19	11:29	69.7	71.2	69.7	75	N
27-Sep-19	14:00	66.6	67.5	63.5	75	N
	Min	65.8	67.0	63.0		
	Max	69.7	71.2	69.7		
	Average	67.6	69.0	66.3		

Location: M3 (Fanling Government Secondary School- Façade)
Day time 07:00-19:00 hrs Normal Weekdays Impact Noise Monitoring Results

	Meas	ured Noise Lev	Limit Level,	Exceedance		
Date	Start Time	Leq	L10	L90	dB(A)^	(Y/N)
4-Sep-19	13:10	60.4	62.5	58.0	70	N
10-Sep-19	13:15	60.1	61.0	57.0	70	N
16-Sep-19	10:09	66.2	68.1	64.3	70	N
27-Sep-19	13:15	61.9	62.5	59.0	70	N
	Min	60.1	61.0	57.0		
	Max	66.2	68.1	64.3		
	Average	62.9	64.5	60.6		

^{* +3}dB(A) Façade effect correction included ^ Limit Level of 70dB(A) applies to education institutes while 65dB(A) applies during school examination period.

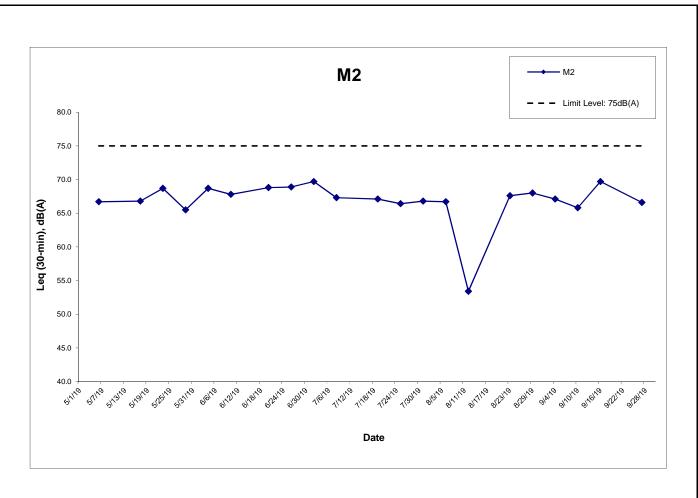

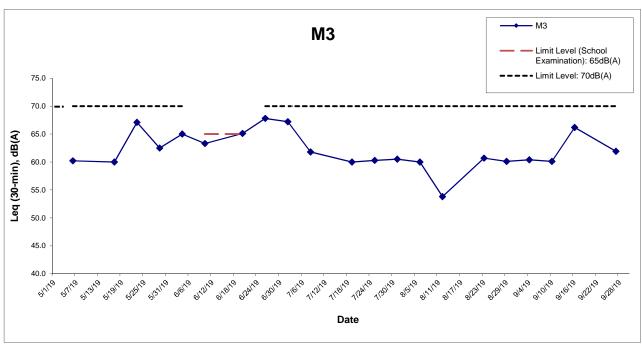

Remark:

^ Limit Level of 70dB(A) applies to education institutes while 65dB(A) applies during school examination period. Examination period of Fanling Government Secondary School (M3) in this reporting period is 10 - 25 June 2019.

CONTRACT NO. HY/2012/06
WIDENING OF FANLING HIGHWAY
- TAI HANG TO WO HOP SHEK INTERCHANGE

Graphical Presentation of Impact Daytime Construction Noise

Monitoring Results

Project No.: 60307376 Date: Oct-19

AECOM

AECO

APPENDIX J EVENT ACTION PLAN

Appendix J – Event Action Plan

Event / Action Plan for Air Quality

Event	Action			
	ET Leader	IEC	ER	Contractor
Action Level				
Exceedance for one sample	Identify source; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to dailv.	Check monitoring data submitted by ET; Check Contractor's working method.	1. Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.
Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate.

Event / Action Plan for Air Quality

Event	Action			
Action Level	ET Leader	IEC	ER	Contractor
Limit Level				
Exceedance for one sample	 Identify source; Inform IEC, ER, Contractor and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise ER on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate.
Exceedance for two or more consecutive samples	 Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase frequency to daily; Analyse Contractor's working procedures to determine possible mitigation to be; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by ER until the exceedance is abated.

Event / Action Plan for Noise Impact

Event	nt Action			
Limit Level	ET Leader	IEC	ER	Contractor
Action Level	 Notify IEC and the Contractor. Carry out investigation. Report the results of investigation to IEC and the Contractor. Discuss with the Contractor and formulate remedial measures. Increase monitoring frequency to check mitigation effectiveness. 	Review with analysed results submitted by ET. Review the proposed remedial measures by the Contractor and advise ER accordingly. Supervise the implement of remedial measures.	 Confirm receipt of notification of failure in writing. Notify the Contractor. Require the Contractor to propose remedial measures for the analysed noise problem. Ensure remedial measures are properly implemented. 	Submit noise mitigation proposals to IEC. Implement noise mitigation proposals.
Limit Level	 Notify, IEC, ER, EPD and the Contractor. Identify the source. Repeat measurement to confirm findings. Increase monitoring frequency. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented. Inform IEC, ER, and EPD the causes & actions taken for the exceedances. Assess effectiveness of the Contractor's remedial actions and keep IEC, EPD and ER informed of the results. If exceedance stops, cease additional monitoring. 		 Confirm receipt of notification of failure in writing. Notify the Contractor. Require the Contractor to propose remedial measures for the analysed noise problem. Ensure remedial measures are properly implemented. If exceedance continues, consider what activity of the work is responsible and instruct the Contractor to stop that activity of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance. Submit proposals for remedial actions to IEC within 3 working days of notification. Implement the agreed proposals. Resubmit proposals if problem still not under control. Stop the relevant activity of works as determined by the ER until the exceedance is abated.

APPENDIX K SITE INSPECTION SUMMARIES

EM&A Environmental Inspection Record



WIDENING OF TOLO HIGHWAY (STAGE 2) BETWEEN TAI HANG AND WO HOP SHEK INTERCHANGE

Site Inspection Summary

Inspection Information

Contract No.	HY/2012/06	
Date:	3 September 2019	
Time:	14:00	
Inspection No.:	303	

Non-compliance

Nil

Observations

Follow-up Observation(s)

1. The construction waste at SA340 has been removed for maintaining site tidiness. (Closed)

New Observation(s)

2. Exposed stockpile of dusty materials without proper cover was observed at NB50A. The Contractor was advised to cover the exposed stockpile entirely with impervious sheeting for dust suppression.

Reminder(s)

Nil.

Remarks

	Name	Signature	Date
Prepared by	Sammi Lam	Sur	3 September 2019
Checked by	Y W Fung	1	3 September 2019





Site Inspection Summary

Inspection Information

Contract No.	HY/2012/06
Date:	10 September 2019
Time:	14:00
Inspection No.:	304

Non-compliance

Nil

Observations

Follow-up Observation(s)

Exposed stockpile of dusty materials without proper cover observed at NB50A has been removed for 1. dust suppression. (Closed)

New Observation(s)

- 2. Oil stain and chemical containers without secondary containment were observed at NB61A. The Contractor was advised to clean up the stain and provide drip tray for the chemical containers to prevent potential leakage.
- Color-faded NRMM label was observed at NB61 and NB61A. The Contractor was advised to affix a 3. proper NRMM label to the equipment before operation.
- Retained waster was observed in a drip tray at NB62. The Contractor was advised to remove the retained water to avoid mosquito breeding.


Reminder(s)


Nil.

Remarks

	Name	Signature	Date
Prepared by	Sammi Lam	Just	10 September 2019
Checked by	Y W Fung	1	10 September 2019

EM&A Environmental Inspection Record







Site Inspection Summary

Inspection Information

Contract No.	HY/2012/06
Date:	19 September 2019
Time:	14:00
Inspection No.:	305

A /	
Non-comp	Manca.
1 1011-001110	ilial luu

Nil

O<u>bservations</u>

Follow-up Observation(s)

- 1. The oil stain and the improper stored chemical containers at NB61A was removed. (Closed)
- 2. NRMM labels of machineries at NB61 and NB61A were replaced. (Closed)
- 3. The reminded waster in the drip trap at NB62 was removed. (Closed)

New Observation(s)


Nil.

Reminder(s)

4. The Contractor was reminded to have fully cover for the stockpile stored at the construction site (SA304).

Remarks

	Name	Signature	Date
Prepared by	Alex Chan	flee	19 September 2019
Checked by	Y W Fung	/	19 September 2019





EM&A Environmental Inspection Record WIDENING OF TOLO HIGHWAY (STAGE 2) BETWEEN TAI HANG AND WO HOP SHEK INTERCHANGE

Site Inspection Summary

Inspection Information

Contract No.	HY/2012/06
Date:	24 September 2019
Time:	14:00
Inspection No.:	306

lon-compliance			
Nil			
Observations			

1.	The stockpile stored at SA304 was fully covered. (Closed)

New Observation(s) Nil.

Follow-up Observation(s)

Reminder(s)

Nil.

R	_	m	2	rl	· c
$\boldsymbol{\kappa}$	91	111	ы	I P	S

	Name	Signature	Date
Prepared by	Alex Chan	flee	24 September 2019
Checked by	Y W Fung	1	24 September 2019

EM&A Environmental Inspection Record





BETWEEN TAI HANG AND WO HOP SHEK INTERCHANGE

Site Inspection Summary

Inspection Information

Contract No.	HY/2012/06
Date:	30 September 2019
Time:	10:00
Inspection No.:	307

Non-compliance

Nil

Observations

Follow-up Observation(s)

Nil

New Observation(s)

- Haul road of construction site was observed dry. The Contractor was advised to implement water 1. spraying frequently for dust suppression.
- 2. General refuse stored without proper receptacle was observed. The Contractor was advised to sort the waste on site and store properly.
- 3. Dust spread was observed during cleaning works carried in the construction site. The Contractor was advised to implement water spraying during dusty work.

Reminder(s)

Nil

Remarks

	Name	Signature	Date
Prepared by	Alex Chan	Alee	30 September 2019
Checked by	Y W Fung	/	30 September 2019

APPENDIX L
STATISTICS ON COMPLAINTS,
NOTIFICATION OF SUMMONS AND
SUCCESSFUL PROSECUTIONS

Appendix L Statistics on Complaints, Notifications of Summons and Successful Prosecutions

Contract No. HY/2012/06 – Widening of Fanling Highway – Tai Hang to Wo Hop Shek Interchange

	Date Received	Subject	Status	Total no. followed up by the ET this month	Total no. followed up by the ET since project commencement
Environmental	19 December 2013	EPD referred a complaint from Lot no. 116 of Fui Sha Wai at Tai Hang of Tai Po which is concerned about the construction noise and diesel-like smell generated from construction activities nearby which caused nuisance and health problems on 19 December 2013 morning.	Closed	0	0
complaints	24 February 2014	EPD referred an air-and-odour complaint on 24 February 2014. The complainant complained about the construction site located near the bus stop in Fui Sha Wai, Tai Hang, Tai Wo Service Road West. When construction works were carried out, odour, white smoke and dust were generated. The complainant asked for follow-up actions.	Closed		8

	Date Received	Subject	Status	Total no. followed up by the ET this month	Total no. followed up by the ET since project commencement
		EPD referred an air complaint on 24 October 2014.			
		A resident complained against the excavation works of Tai Wo			
	00 0 atalaa	Service Road West between Nam Wah Po & Tai Hang Tsuen, which			
	23 October 2014	have piled up high stockpiles, causing serious dust nuisance to his house.	Closed		
		The resident also complained that the stockpiles have not been			
		covered and watered properly. He now requires the EPD to follow up.			
		The location of complaint is near Lamppost Location EB5717.			
		EPD referred a water complaint on 31 December 2014.			
	31	The complainant complained about the muddy river outside Tai Hang			
	December	Village Office on 29 December 2014. It was suspected that the muddy	Closed		
	2014	water was discharged from the construction works of the Project.			
		He required the EPD to follow up.			
		EPD referred a water complaint on 25 March 2015.			
		The complainant complained about the generation of the smell of			
	25 March	gasoline from the Widening of Fanling Highway construction site on			
	2015	Tai Wo Service Road West, causing serious nuisance to nearby	Closed		
		houses.			
		The situation has continued for a few weeks and she asked the EPD			
		to follow up as soon as possible.			

Date Received	Subject	Status	Total no. followed up by the ET this month	Total no. followed up by the ET since project commencement
5 January 2017 (Referred by the Contractor on 13 January 2017)	A complaint was received by the 1823 enquiry and complaint hotline on 5 January 2017. The complaint was referred to the Environmental Team by the Contractor on 13 January 2017. The complainant complained against the dust emission generated by the Widening of Fanling Highway construction site on Tai Wo Service Road West near Tai Hang Village. The complainant also complained that Highway Department did not conduct road surface cleansing, which affects residents' health. He/she now requires the Highway Department to follow up.	Closed		
22 May 2017 (Referred by the Contractor on 23 May 2017)	A complaint was received by the 1823 enquiry and complaint hotline on 22 May 2017. The complaint was referred to the Environmental Team by the Contractor on 23 May 2017. A complainant complained that construction noise was caused by the erection of noise barrier on Tai Wo Service Road West near Tai Hang Village on Sunday(s). The complainant concerned about if any Construction Noise Permit is issued by the Environmental Protection Department.	Closed		

	Date Received	Subject	Status	Total no. followed up by the ET this month	Total no. followed up by the ET since project commencement
	25 February 2018 (Referred by the Contractor on 1 March 2018)	The 1823 enquiry and complaint hotline received a complaint on 25 February 2018. The complaint was referred to the Environmental Team by the Contractor on 1 March 2018. A complainant complained that noise nuisance was caused continuously by road construction works at Fanling Highway near Tai Hang Village during 01:30 to 04:00 on 25 February 2018. The complainant concerned that the nuisance affects residence and asked for follow-up action from the related department.			
Notification of summons	-	-	-	0	0
Successful Prosecutions	-	-	-	0	0

Contract No. 02/HY/2015 – Provision of Bus-Bus Interchange on Fanling Highway Kowloon Bound

	Date Received	Subject	Status	Total no. followed up by the ET this month	Total no. followed up by the ET since project commencement
Environmental complaints	-	-	-	0	0
Notification of summons	-	-	-	0	0
Successful Prosecutions	-	-	-	0	0