

東業德勤測試顧問有限公司

ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong

Tel : 2695 8318

E-mail : etl@ets-testconsult.com

Fax : 2695 3944

Web site : www.ets-testconsult.com


CHINA HARBOUR ENGINEERING CO., LTD.

**CONTRACT NO.: HY/2013/02 HONG
KONG – ZHUHAI- MACAO BRIDGE
HONG KONG BOUNDARY CROSSING
FACILITIES – INFRASTRUCTURE
WORKS STAGE I (WESTERN PORTION)**


**MONTHLY EM&A REPORT
NO. 4**

(01 MARCH - 31 MARCH 2015)

Prepared by:


LAU, Chi Leung
Environmental Team Leader

Certified by:


LAU, Chi Leung
Environmental Team Leader

Issued Date: 10 April 2015

Report No.: ENA50570

Ref.: HYDHZMBEEM00_0_2877L.15

15 April 2015

By Fax (3468 2076) and By Post

AECOM Asia Co. Ltd.
The PRE's Offices,
5 Ying Hei Road,
Tung Chung, Lantau,
Hong Kong

Attention: Mr. Ringo Tso

Dear Sir,

**Re: Agreement No. CE 48/2011 (EP)
Environmental Project Office for the
HZMB Hong Kong Link Road, HZMB Hong Kong Boundary Crossing Facilities,
and Tuen Mun-Chek Lap Kok Link – Investigation**

**Contract No. HY/2013/02 – HZMB HKBCF – Infrastructure Works Stage I
(Western Portion)
Monthly Environmental Monitoring & Audit Report for March 2015**

Reference is made to the Environmental Team's submission of the Monthly Environmental Monitoring & Audit Report for March 2015 certified by the ET Leader (ET's ref.: "OC/50193/CLL" dated 13 April 2015) and provided to us via e-mail on 14 April 2015.

We are pleased to inform you that we have no adverse comment on the captioned Monthly EM&A Report. We write to verify the captioned submission in accordance with Condition 5.4 of the Environmental Permit No. EP-353/2009/H.

Thank you for your kind attention. Please do not hesitate to contact the undersigned should you have any queries.

Yours sincerely,




Raymond Dai
Independent Environmental Checker

c.c.	HyD	Mr. Matthew Fung	(By Fax: 3188 6614)
	HyD	Mr. Chee-Kuen Yu	(By Fax: 3188 6614)
	ETS	Mr. C. L. Lau	(By Fax: 2695 3944)
	CHEC	Mr. Kenny Yu	(By Fax: 3915 0300)


Internal: DY, YH, SL, JM, ENPO Site

Q:\Projects\HYDHZMBEEM00\02_Proj_Mgt\02_Corr\HYDHZMBEEM00_0_2877L.15.doc

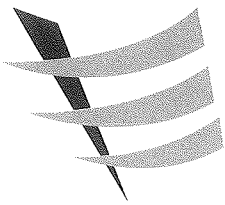

東業德勤測試顧問有限公司
ETS-TESTCONSULT LIMITED

8/F., Block B, Veristrong Industrial Centre, 34-36 Au Pui Wan Street, Fotan, Hong Kong
Tel : 2695 8318 E-mail : etl@ets-testconsult.com
Fax : 2695 3944 Web site : www.ets-testconsult.com

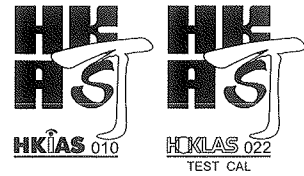

Your Ref. : ---
Our Ref. : OC/50193/CLL

13 April 2015

ENVIRON Hong Kong Limited
Room 2403, Jubilee Centre
18 Fenwick Street,
Wan Chai
Hong Kong

By Post and E-mail


Attn: Mr. Raymond Dai

Dear Mr. Dai,

Contract No. HY/2013/02
Hong Kong – Zhuhai – Macao Bridge
Hong Kong Boundary Crossing Facilities – Infrastructure Works Stage I (Western Portion)
Monthly EM&A Report for March 2015

In accordance with the requirement specified in Condition 5.4 of the Environmental Permit No. EP-353/2009/H, we are pleased to submit the certified EM&A Report for March 2015 revised with the IEC's comment for your onward verification.

Yours faithfully,
ETS-TESTCONSULT LIMITED



Mr. C. L. Lau
Environmental Team Leader

CLL/ry



TABLE OF CONTENTS		Page
EXECUTIVE SUMMARY		
1	INTRODUCTION	1
1.1	Basic Project Information	1
1.2	Project Organization	2
1.3	Construction Programme	2
1.4	Construction Works Undertaken During the Reporting Period	2
2	AIR QUALITY MONITORING	3
2.1	Monitoring Locations	3
2.2	Monitoring Requirements	3
2.3	Monitoring Results	4
3	NOISE MONITORING	5
3.1	Monitoring Locations	5
3.2	Monitoring Requirements	5
3.3	Monitoring Results	5
4	ENVIRONMENTAL SITE INSPECTION AND AUDIT	6
4.1	Site Inspection	6
4.2	Advice on the Solid and Liquid Waste Management Status	6
4.3	Environmental Licenses and Permits	6
4.4	Implementation Status of Environmental Mitigation Measures	7
4.5	Summary of Exceedance of the Environmental Quality Performance Limit	7
4.6	Summary of Complaints, Notification of Summons and Successful Prosecution	7
5	FUTURE KEY ISSUES	8
5.1	Construction Programme for the Coming Months	8
5.2	Environmental Site Inspection Schedule for the Coming Month	8
6	CONCLUSION	8
	Conclusions	8

FIGURES

Figure 2 Air Quality and Noise Monitoring Stations for HKBCF

APPENDICES

Appendix A	Location of Works Areas
Appendix B	Project Organization for Environmental Works
Appendix C	Construction Programme
Appendix D	Event and Action Plan
Appendix E	Waste Flow Table
Appendix F	Environmental Licenses and Permits
Appendix G	Implementation Schedule for Environmental Mitigation Measures (EMIS)
Appendix H	Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions
Appendix I	Environmental Site Inspection Schedule



EXECUTIVE SUMMARY

This Monthly Environmental Monitoring and Audit (EM&A) Report is prepared for Contract HY/2013/02 Hong Kong–Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) – Infrastructure Works Stage I (Western Portion) (hereafter referred to as “the Contract”) for the Highways Department of Hong Kong Special Administrative Region (HKSAR). The Contract was awarded to China Harbour Engineering Co., Ltd. (hereafter referred to as “the Contractor”) and ETS-Testconsult Limited was appointed as the Environmental Team (ET) by the Contractor.

The Contract is part of Hong Kong – Zhuhai – Macao Bridge HKBCF which is a “Designated Project”, under Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO) (Cap 499) and Environmental Impact Assessment (EIA) Report (Register No. AEIAR-145/2009) was prepared for the Project. The current Environmental Permit (EP) No. EP-353/2009/H for HKBCF was issued on 19 January 2015. These documents are available through the EIA Ordinance Register. Site preparation works of the Contract was started on 25 July 2014 and the construction works of the Contract commenced on 24 November 2014.

ETS-Testconsult Limited has been appointed by the Contractor to implement the Environmental Monitoring & Audit (EM&A) programme for the Contract in accordance with the Updated EM&A Manual for HKBCF (Version 1.0) and provide environmental team services to the Contract.

This is the fourth Monthly Environmental Monitoring and Audit (EM&A) Report for the Contract which summaries findings of the EM&A works conducted during the reporting period from 01 March 2015 to 31 March 2015.

Site Activities

As informed by the Contractor, site activities were carried out in this reporting month:

- *Pre-Drilling Work at Main Site;*
- *Bored Piles Works at Main Site;*
- *Secondary site office erection at Main Site; and*
- *Storm & Sewer Drain Works at Main Site.*

Environmental Monitoring and Audit Progress

The monthly EM&A programme was undertaken in accordance with the Updated EM&A Manual for HKBCF (Version 1.0). It should be noted that the air quality and noise monitoring works for the Contract are covered by Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge HKBCF – Reclamation Works and Contract No. HY/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between Scenic Hill and HKBCF. The ET of the Contract or another ET of the HZMB project is required to conduct impact air quality monitoring at AMS6 and AMS7A and noise monitoring at NMS2 and NMS3B as part of EM&A programme if these monitoring stations are no longer covered under Contract No. HY/2010/02 and HY/2011/03. However, this is subject to ENPO’s final decision on which ET should carry out the monitoring works at these stations.

The date of site inspection during the reporting period are listed below:

Environmental Site Inspection 06,10,20, 24 and 31 March 2015

Breaches of Action and Limit Levels

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS6 by the Environmental Team of Contract No. HY/2011/03 during the reporting period.

There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.

There was no Action and Limit Level exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.



Complaint Log

There was no complaint received in relation to the environmental impact during the reporting period.

Notifications of Summons and Successful Prosecutions

There were no notifications of summons or prosecutions received during the reporting period.

Reporting Change

There was no reporting change in the reporting period.

Future Key Issues

The future key issues to be undertaken in the upcoming month are as follows:

- *Pre-Drilling Work at Main Site;*
- *Bored Piles Works at Main Site;*
- *Secondary site office erection at Main Site; and*
- *Storm & Sewer Drain Works at Main Site.*



1 INTRODUCTION

1.1 Basic Project Information

1.1.1 This Monthly Environmental Monitoring and Audit (EM&A) Report is prepared for Contract HY/2013/02 Hong Kong–Zhuhai-Macao Bridge Hong Kong Boundary Crossing Facilities (HKBCF) – Infrastructure Works Stage I (Western Portion) (hereafter referred to as “the Contract”) for the Highways Department of Hong Kong Special Administrative Region (HKSAR). The Contract was awarded to China Harbour Engineering Co., Ltd. (hereafter referred to as “the Contractor”) and ETS-Testconsult Limited was appointed as the Environmental Team (ET) by the Contractor.

1.1.2 The Contract is part of Hong Kong – Zhuhai – Macao Bridge HKBCF which is a “Designated Project”, under Schedule 2 of the Environmental Impact Assessment Ordinance (EIAO) (Cap 499) and Environmental Impact Assessment (EIA) Report (Register No. AEIAR-145/2009) was prepared for the Project. The current Environmental Permit (EP) No. EP-353/2009/H for HKBCF was issued on 19 January 2015. These documents are available through the EIA Ordinance Register. Site preparation works of the Contract started on 25 July 2014 and the construction works of the Contract commenced on 24 November 2014. The works area of the Contract is shown in **Appendix A**.

1.1.3 The proposed works under this Contract comprise the following:

- Construction of the viaducts and roads at the western portion of Hong Kong Boundary Crossing Facilities (HKBCF) mainly for connection with the Hong Kong – Zhuhai – Macao Bridge (HZMB), Hong Kong Link Road (HKLR), Hong Kong International Airport (HKIA) and the Tuen Mun-Chek Lap Kok Link (TM-CLKL);
- Construction of the road modification at the SkyCity Interchange at Airport Island;
- Construction of associated street lighting, street furniture, road marking, road signage, drainage, sewerage, fresh water and flushing water supply, irrigation, landscape, electrical and mechanical (E&M), utilities and services works;
- Provisioning of civil engineering works and power supply installation for the Traffic Control and Surveillance System TCSS);
- Other works in accordance with the Contract.

1.1.4 This is the fourth Monthly Environmental Monitoring and Audit (EM&A) Report for the Contract which summaries the audit findings of the EM&A programme during the reporting period from 01 March 2015 to 31 March 2015.



1.2 Project Organization

1.2.1 The project organization structure and lines of communication with respect to the on-site environmental management structure is shown in **Appendix B**. The key personnel contact names and numbers are summarized in **Table 1.1**.

Table 1.1 Contact Information of Key Personnel

Party	Position	Name of Key Staff	Tel. No.	Fax No.
Engineer or Engineer's Representative (AECOM Asia Co. Ltd.)	Resident Engineer	Mr. Fred Yeung	63308293	31525116
Environmental Project Office / Independent Environmental Checker (Environ Hong Kong Limited)	Environmental Project Office Leader	Mr. Y. H. Hui	34652888	34652899
	Independent Environmental Checker	Mr. Raymond Dai	34652888	34652899
	Environmental Site Supervisor	Mr. Ray Yan	51818165	34652899
Contractor (China Harbour Engineering Co., Ltd.)	Environmental Officer	Mr. K. F. Wong	93724383	39150300
	Environmental Engineer	Mr. Calvin So	97246254	39150300
	Environmental Supervisor	Ms. Joy Chan	54005086	39150300
	Environmental Supervisor	Ms. Selena Yang	55122662	39150300
Environmental Team (ETS-Testconsult Ltd.)	Environmental Team Leader	Mr C. L. Lau	2946 7791	2695 3944

1.3 Construction Programme

1.3.1 A copy of the Contractor's construction programme is provided in **Appendix C**.

1.4 Construction Works Undertaken During the Reporting Period

1.4.1

A summary of the construction activities undertaken during this reporting period is shown below:

- Pre-Drilling Work at Main Site;
- Bored Piles Works at Main Site;
- Secondary site office erection at Main Site; and
- Storm & Sewer Drain Works at Main Site.



2 AIR QUALITY MONITORING

2.1 Monitoring Locations

2.1.1 The air quality monitoring works for the Contract are covered by Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge HKBCF – Reclamation Works and Contract No. HY/2011/03 Hong Kong-Zhuhai-Macao Bridge Hong Kong Link Road – Section between Scenic Hill and HKBCF. The ET of the Contract or another ET of the HZMB project is required to conduct impact air quality monitoring at AMS6 and AMS7A as part of EM&A programme if these air quality monitoring stations are no longer covered under Contract No. HY/2010/02 and HY/2011/03. **Figure 2** shows the locations of air monitoring stations.

Table 2.1 Air Quality Monitoring Locations

Identification No.	Location Description
AMS6 ⁽¹⁾	Dragonair / CNAC (Group) Building
AMS7A ⁽¹⁾	Chu Kong Air-Sea Union Transportation Co. Ltd.

Remarks:

- (1) The ET of this Contract should conduct impact air quality monitoring at the AMS listed in the table as part of EM&A programme according to latest notification from ENPO when the monitoring station(s) is/are no longer covered by another ET of the HZMB project.

2.2 Monitoring Requirements

2.2.1 The monitoring requirements, monitoring equipment, monitoring parameters, frequency and duration, monitoring methodology, monitoring schedule, meteorological information are detailed in the monthly EM&A Reports prepared for Contract Nos. HY/2010/02 and HY/2011/03.

2.2.2 The Action and Limit Levels for 1-hr TSP and 24-hr TSP are provided in **Table 2.2** and **Table 2.3** respectively.

Table 2.2 Action and Limit Levels for 1-hour TSP

Monitoring Station.	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS6 – Dragnair / SNAC (Group) Building (HKIA)	360	500
AMS7A – Chu Kong Air-Sea Union Transportation Co. Ltd.	370	500

Table 2.3 Action and Limit Levels for 24-hour TSP

Monitoring Station.	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
AMS6 – Dragnair / SNAC (Group) Building (HKIA)	173	260
AMS7A – Chu Kong Air-Sea Union Transportation Co. Ltd.	183	260

2.2.3 The event and action plan is provided in **Appendix D**.

2.2.4 If exceedance(s) at these stations is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the monthly EM&A Report.



2.3 Monitoring Results

- 2.3.1** The monitoring results for AMS6 and AMS7A are reported in the monthly EM&A Reports prepared for Contract Nos. HY/2011/03 and HY/2010/02 respectively.
- 2.3.2** There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS6 by the Environmental Team of Contract No. HY/2011/03 during the reporting period.
- 2.3.3** There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.



3 NOISE MONITORING

3.1 Monitoring Locations

3.1.1 The noise monitoring works for the Contract are covered by Contract No. HY/2010/02 Hong Kong-Zhuhai-Macao Bridge HKBCF – Reclamation Works. The ET of the Contract or another ET of the HZMB project is required to conduct noise monitoring at NMS2 and NMS3B as part of EM&A programme if these monitoring stations are no longer covered under Contract No. HY/2010/02. **Figure 2** shows the locations of noise monitoring stations.

Table 3.1 Construction Noise Monitoring Locations

Identification No.	Location Description
NMS2 ⁽¹⁾	Seaview Crescent
NMS3B ^{(1) (2)}	Site Boundary of Site Office Area at Works Area WA2

Remarks:

- (1) The ET of this Contract should conduct impact noise monitoring at the NMS listed in the table as part of EM&A programme according to latest notification from ENPO when the monitoring station(s) is/are no longer covered by another ET of the HZMB project.
- (2) The Action and Limit Levels for schools will be applied for this alternative monitoring location.

3.2 Monitoring Requirements

3.2.1 The monitoring requirements, monitoring equipment, monitoring parameters, frequency and duration, monitoring methodology, monitoring schedule, meteorological information are detailed in the monthly EM&A Reports prepared for Contract No. HY/2010/02.

3.2.2 The Action and Limit Levels for construction noise are provided in **Table 3.2**

Table 3.2 Action and Limit Levels for Construction Noise

Parameter	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received	75 dB(A)*

Notes :

If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the Noise Control Authority have to be followed.

* Reduce to 70 dB(A) for schools and 65 dB(A) during school examination period.

3.2.3 The event and action plan is provided in **Appendix D**.

3.2.4 If exceedance(s) at these stations is/are recorded by the ET of the Contract or referred by the other ET under the HZMB project to the Contract, the ET of the Contract will carry out an investigation and findings will be reported in the monthly EM&A Report.

3.3 Monitoring Results

3.3.1 The monitoring results for NMS2 and NMS3B are reported in the monthly EM&A Reports prepared for Contract No. HY/2010/02. There was no exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.



4 ENVIRONMENTAL SITE INSPECTION AND AUDIT

4.1 Site Inspection

4.1.1 Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control mitigation measures for the project. During the reporting period, site inspections were carried out on 06, 10, 20, 24 and 31 March 2015.

4.1.2 Particular observations during the site inspections are described below:

24 February 2015

(a) Accumulated water was observed on the floor at Portion D. The Accumulated water was cleaned. This observation was closed on 06 March 2015.

06 March 2015

(a) No observation was made.

10 March 2015

(a) General refuse was observed at WA3. The general refuse was collected. This observation was closed on 20 March 2015.

20 March 2015

(a) No observation was made.

24 March 2015

(a) No observation was made.

31 March 2015

(a) Oil stain was found on the floor at Portion H. The Contractor was reminded to clean the oil stain. Follow-up actions for the outstanding observation will be inspected during the next site inspection.

4.2 Advice on the Solid and Liquid Waste Management Status

4.2.1 The Contractor registered as a chemical waste producer for the Contract. Sufficient numbers of receptacles were available for general refuse collection and sorting.

4.2.2 No generation of excavated sediment for treatment during this reporting period. Excavated marine sediment will be treated using cement solidification/stabilization (Cement S/S) techniques and will be reused onsite for either backfilling or landscaping (e.g. berm material).

4.2.3 The monthly summary of waste flow table is detailed in **Appendix E**.

4.2.4 The Contractor was reminded that chemical waste containers should be properly treated and stored temporarily in designated chemical waste storage area on site in accordance with the Code of Practice on the Packing, Labelling and Storage of Chemical Waste.

4.3 Environmental Licenses and Permits

4.3.1 The valid environmental licenses and permits during the reporting period are summarized in **Appendix F**.



4.4 Implementation Status of Environmental Mitigation Measures

- 4.4.1 In response to the site audit findings, the Contractor carried out corrective actions.
- 4.4.2 The Contractor waters 8 times per day on all exposed soil within the project site and associated works areas when construction activities are being undertaken.
- 4.4.3 A summary of the implementation Schedule of Environmental Mitigation Measures (EMIS) is presented in **Appendix G**. Most of the necessary mitigation measures were implemented properly.

4.5 Summary of Exceedance of the Environmental Quality Performance Limit

- 4.5.1 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS6 by the Environmental Team of Contract No. HY/2011/03 during the reporting period.
- 4.5.2 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.
- 4.5.3 There was no Action and Limit Level exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.

4.6 Summary of Complaints, Notification of Summons and Successful Prosecution

- 4.6.1 There was no complaint received in relation to the environmental impact during the reporting period.
- 4.6.2 There were no notifications of summons or prosecutions received during the reporting period.
- 4.6.3 Statistics on environmental complaints, notifications of summons and successful prosecutions are summarized in **Appendix H**.



5 FUTURE KEY ISSUES

5.1 Construction Programme for the Coming Months

5.1.1 As informed by the Contractor, the major construction activities for March 2015 are summarized in Table 5.1.

Table 5.1 Construction Activities for March 2015

Site Area	Description of Activities
Main Site	Pre-Drilling Work
Main Site	Bored Piles Works
Main Site	Secondary site office erection
Main Site	Storm & Sewer Drain Works

5.2 Environmental Site Inspection Schedule for the Coming Month

5.2.1 The tentative schedule for weekly site inspections for April 2015 is provided in **Appendix I**

6 CONCLUSION.

6.1 Conclusions

- 6.1.1 The site preparation work of the Contract was started on 25 July 2014 and the construction works of the Contract commenced on 24 November 2014.
- 6.1.2 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS6 by the Environmental Team of Contract No. HY/2011/03 during the reporting period.
- 6.1.3 There was no Action and Limit Level exceedance of 1-hr TSP level and 24-hr TSP level recorded at station AMS7A by the Environmental Team of Contract No. HY/2010/02 during the reporting period.
- 6.1.4 There was no Action and Limit Level exceedance for noise recorded at station NMS2 and station NMS3B by the Environmental Team of Contract No. HY/2010/02 during the reporting period.
- 6.1.5 There was no complaint received in relation to the environmental impact during the reporting period.
- 6.1.6 There were no notifications of summons or prosecutions received during the reporting period.



FIGURES

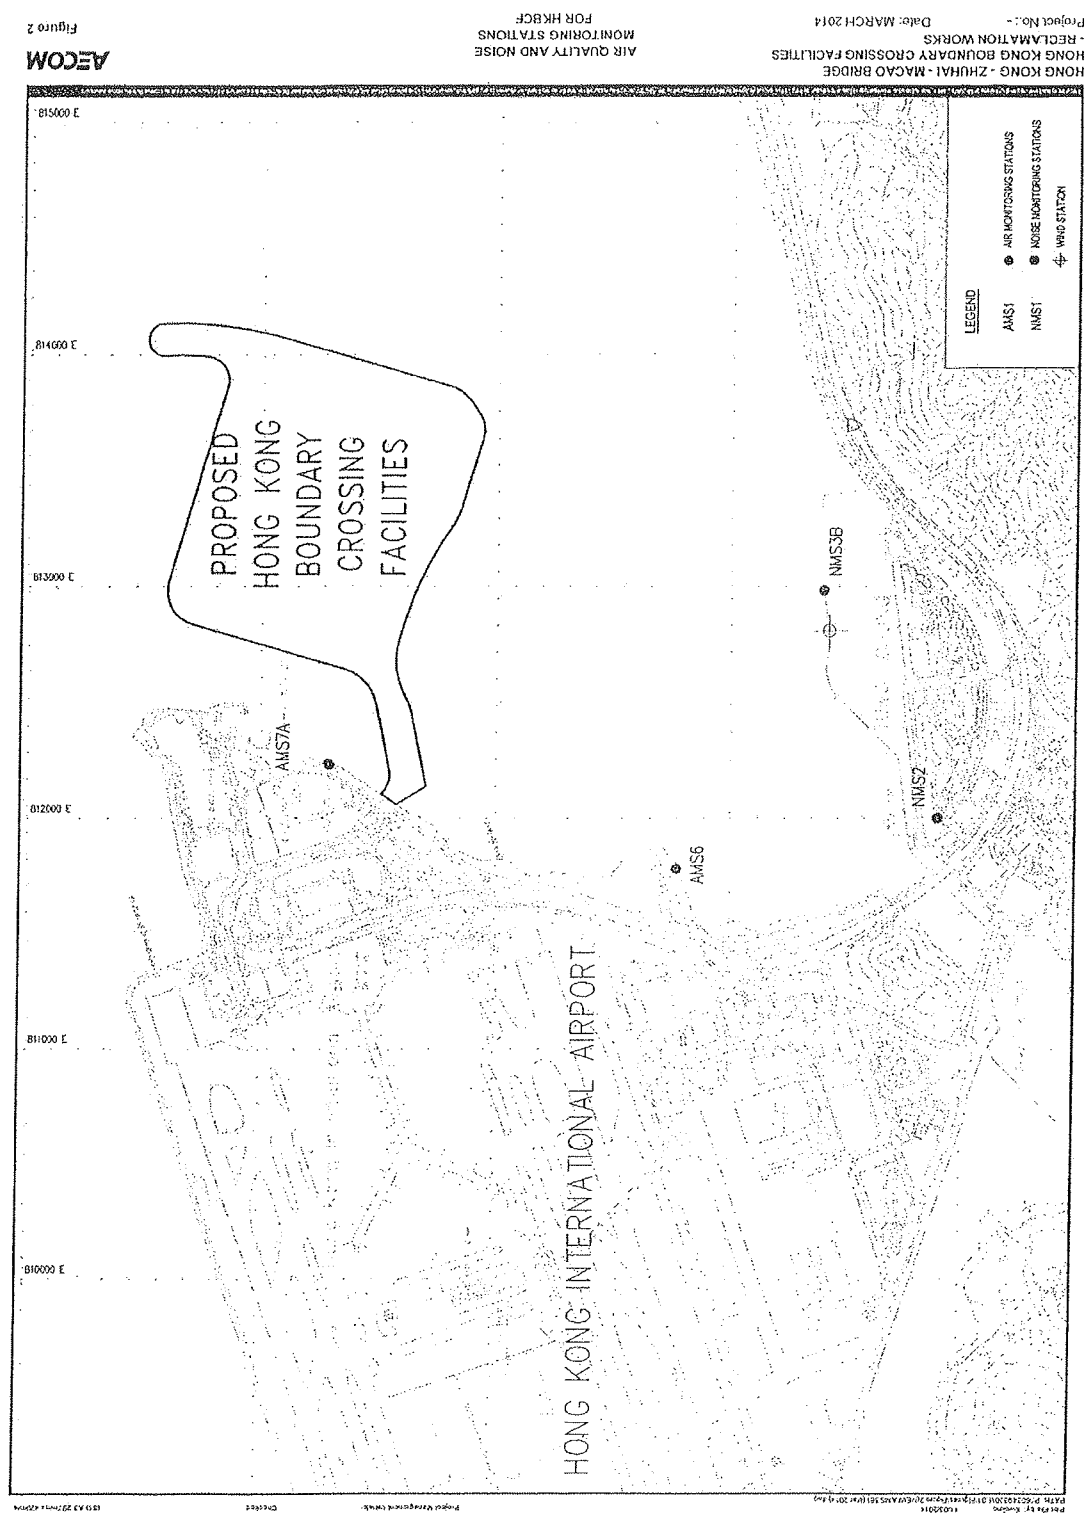


Figure 2
 AIR QUALITY AND NOISE MONITORING STATIONS FOR HKBCF
 Date: MARCH 2014
 Project No. -
 HONG KONG - ZHUHAI - MACAO BRIDGE
 HONG KONG BOUNDARY CROSSING FACILITIES
 RECLAMATION WORKS




Appendix A

Location of Works Areas


NOTES:

1. DIMENSIONS ARE IN METERS UNLESS OTHERWISE SPECIFIED.
2. DIMENSIONS ARE IN METERS UNLESS OTHERWISE SPECIFIED.
3. THIS DRAWING IS FOR INFORMATION ONLY AND DOES NOT REPRESENT A CONTRACT.



LEGEND:

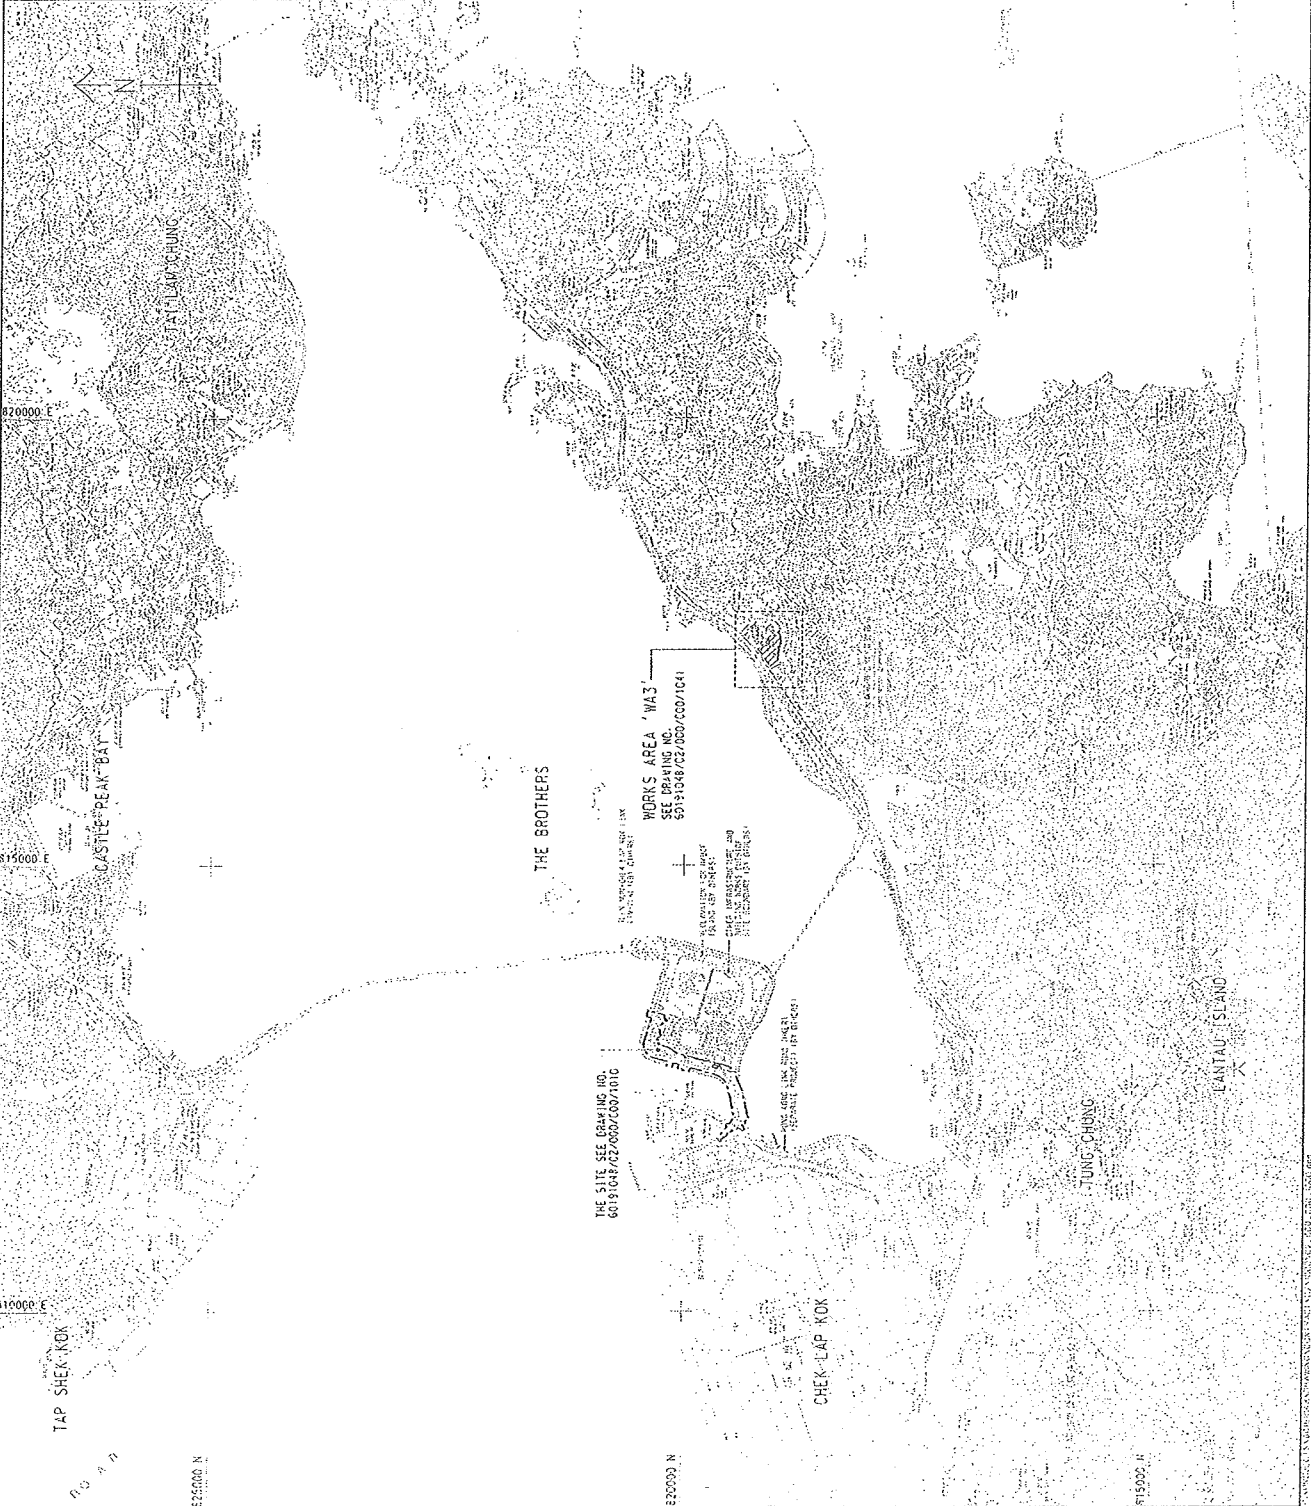

REVISIONS
 NO. DATE BY
 1 10/10/08 JH
 2 11/10/08 JH
 3 12/10/08 JH
 4 01/11/08 JH
 5 02/11/08 JH
 6 03/11/08 JH
 7 04/11/08 JH
 8 05/11/08 JH
 9 06/11/08 JH
 10 07/11/08 JH
 11 08/11/08 JH
 12 09/11/08 JH
 13 10/11/08 JH
 14 11/11/08 JH
 15 12/11/08 JH
 16 01/12/08 JH
 17 02/12/08 JH
 18 03/12/08 JH
 19 04/12/08 JH
 20 05/12/08 JH
 21 06/12/08 JH
 22 07/12/08 JH
 23 08/12/08 JH
 24 09/12/08 JH
 25 10/12/08 JH
 26 11/12/08 JH
 27 12/12/08 JH
 28 01/01/09 JH
 29 02/01/09 JH
 30 03/01/09 JH
 31 04/01/09 JH
 32 05/01/09 JH
 33 06/01/09 JH
 34 07/01/09 JH
 35 08/01/09 JH
 36 09/01/09 JH
 37 10/01/09 JH
 38 11/01/09 JH
 39 12/01/09 JH
 40 01/02/10 JH
 41 02/02/10 JH
 42 03/02/10 JH
 43 04/02/10 JH
 44 05/02/10 JH
 45 06/02/10 JH
 46 07/02/10 JH
 47 08/02/10 JH
 48 09/02/10 JH
 49 10/02/10 JH
 50 11/02/10 JH
 51 12/02/10 JH
 52 01/03/11 JH
 53 02/03/11 JH
 54 03/03/11 JH
 55 04/03/11 JH
 56 05/03/11 JH
 57 06/03/11 JH
 58 07/03/11 JH
 59 08/03/11 JH
 60 09/03/11 JH
 61 10/03/11 JH
 62 11/03/11 JH
 63 12/03/11 JH
 64 01/04/12 JH
 65 02/04/12 JH
 66 03/04/12 JH
 67 04/04/12 JH
 68 05/04/12 JH
 69 06/04/12 JH
 70 07/04/12 JH
 71 08/04/12 JH
 72 09/04/12 JH
 73 10/04/12 JH
 74 11/04/12 JH
 75 12/04/12 JH
 76 01/05/13 JH
 77 02/05/13 JH
 78 03/05/13 JH
 79 04/05/13 JH
 80 05/05/13 JH
 81 06/05/13 JH
 82 07/05/13 JH
 83 08/05/13 JH
 84 09/05/13 JH
 85 10/05/13 JH
 86 11/05/13 JH
 87 12/05/13 JH
 88 01/06/14 JH
 89 02/06/14 JH
 90 03/06/14 JH
 91 04/06/14 JH
 92 05/06/14 JH
 93 06/06/14 JH
 94 07/06/14 JH
 95 08/06/14 JH
 96 09/06/14 JH
 97 10/06/14 JH
 98 11/06/14 JH
 99 12/06/14 JH
 100 01/07/15 JH
 101 02/07/15 JH
 102 03/07/15 JH
 103 04/07/15 JH
 104 05/07/15 JH
 105 06/07/15 JH
 106 07/07/15 JH
 107 08/07/15 JH
 108 09/07/15 JH
 109 10/07/15 JH
 110 11/07/15 JH
 111 12/07/15 JH
 112 01/08/16 JH
 113 02/08/16 JH
 114 03/08/16 JH
 115 04/08/16 JH
 116 05/08/16 JH
 117 06/08/16 JH
 118 07/08/16 JH
 119 08/08/16 JH
 120 09/08/16 JH
 121 10/08/16 JH
 122 11/08/16 JH
 123 12/08/16 JH
 124 01/09/17 JH
 125 02/09/17 JH
 126 03/09/17 JH
 127 04/09/17 JH
 128 05/09/17 JH
 129 06/09/17 JH
 130 07/09/17 JH
 131 08/09/17 JH
 132 09/09/17 JH
 133 10/09/17 JH
 134 11/09/17 JH
 135 12/09/17 JH
 136 01/10/18 JH
 137 02/10/18 JH
 138 03/10/18 JH
 139 04/10/18 JH
 140 05/10/18 JH
 141 06/10/18 JH
 142 07/10/18 JH
 143 08/10/18 JH
 144 09/10/18 JH
 145 10/10/18 JH
 146 11/10/18 JH
 147 12/10/18 JH
 148 01/11/19 JH
 149 02/11/19 JH
 150 03/11/19 JH
 151 04/11/19 JH
 152 05/11/19 JH
 153 06/11/19 JH
 154 07/11/19 JH
 155 08/11/19 JH
 156 09/11/19 JH
 157 10/11/19 JH
 158 11/11/19 JH
 159 12/11/19 JH
 160 01/12/20 JH
 161 02/12/20 JH
 162 03/12/20 JH
 163 04/12/20 JH
 164 05/12/20 JH
 165 06/12/20 JH
 166 07/12/20 JH
 167 08/12/20 JH
 168 09/12/20 JH
 169 10/12/20 JH
 170 11/12/20 JH
 171 12/12/20 JH
 172 01/01/21 JH
 173 02/01/21 JH
 174 03/01/21 JH
 175 04/01/21 JH
 176 05/01/21 JH
 177 06/01/21 JH
 178 07/01/21 JH
 179 08/01/21 JH
 180 09/01/21 JH
 181 10/01/21 JH
 182 11/01/21 JH
 183 12/01/21 JH
 184 01/02/22 JH
 185 02/02/22 JH
 186 03/02/22 JH
 187 04/02/22 JH
 188 05/02/22 JH
 189 06/02/22 JH
 190 07/02/22 JH
 191 08/02/22 JH
 192 09/02/22 JH
 193 10/02/22 JH
 194 11/02/22 JH
 195 12/02/22 JH
 196 01/03/23 JH
 197 02/03/23 JH
 198 03/03/23 JH
 199 04/03/23 JH
 200 05/03/23 JH
 201 06/03/23 JH
 202 07/03/23 JH
 203 08/03/23 JH
 204 09/03/23 JH
 205 10/03/23 JH
 206 11/03/23 JH
 207 12/03/23 JH
 208 01/04/24 JH
 209 02/04/24 JH
 210 03/04/24 JH
 211 04/04/24 JH
 212 05/04/24 JH
 213 06/04/24 JH
 214 07/04/24 JH
 215 08/04/24 JH
 216 09/04/24 JH
 217 10/04/24 JH
 218 11/04/24 JH
 219 12/04/24 JH
 220 01/05/25 JH
 221 02/05/25 JH
 222 03/05/25 JH
 223 04/05/25 JH
 224 05/05/25 JH
 225 06/05/25 JH
 226 07/05/25 JH
 227 08/05/25 JH
 228 09/05/25 JH
 229 10/05/25 JH
 230 11/05/25 JH
 231 12/05/25 JH
 232 01/06/26 JH
 233 02/06/26 JH
 234 03/06/26 JH
 235 04/06/26 JH
 236 05/06/26 JH
 237 06/06/26 JH
 238 07/06/26 JH
 239 08/06/26 JH
 240 09/06/26 JH
 241 10/06/26 JH
 242 11/06/26 JH
 243 12/06/26 JH
 244 01/07/27 JH
 245 02/07/27 JH
 246 03/07/27 JH
 247 04/07/27 JH
 248 05/07/27 JH
 249 06/07/27 JH
 250 07/07/27 JH
 251 08/07/27 JH
 252 09/07/27 JH
 253 10/07/27 JH
 254 11/07/27 JH
 255 12/07/27 JH
 256 01/08/28 JH
 257 02/08/28 JH
 258 03/08/28 JH
 259 04/08/28 JH
 260 05/08/28 JH
 261 06/08/28 JH
 262 07/08/28 JH
 263 08/08/28 JH
 264 09/08/28 JH
 265 10/08/28 JH
 266 11/08/28 JH
 267 12/08/28 JH
 268 01/09/29 JH
 269 02/09/29 JH
 270 03/09/29 JH
 271 04/09/29 JH
 272 05/09/29 JH
 273 06/09/29 JH
 274 07/09/29 JH
 275 08/09/29 JH
 276 09/09/29 JH
 277 10/09/29 JH
 278 11/09/29 JH
 279 12/09/29 JH
 280 01/10/30 JH
 281 02/10/30 JH
 282 03/10/30 JH
 283 04/10/30 JH
 284 05/10/30 JH
 285 06/10/30 JH
 286 07/10/30 JH
 287 08/10/30 JH
 288 09/10/30 JH
 289 10/10/30 JH
 290 11/10/30 JH
 291 12/10/30 JH
 292 01/11/31 JH
 293 02/11/31 JH
 294 03/11/31 JH
 295 04/11/31 JH
 296 05/11/31 JH
 297 06/11/31 JH
 298 07/11/31 JH
 299 08/11/31 JH
 300 09/11/31 JH
 301 10/11/31 JH
 302 11/11/31 JH
 303 12/11/31 JH
 304 01/12/32 JH
 305 02/12/32 JH
 306 03/12/32 JH
 307 04/12/32 JH
 308 05/12/32 JH
 309 06/12/32 JH
 310 07/12/32 JH
 311 08/12/32 JH
 312 09/12/32 JH
 313 10/12/32 JH
 314 11/12/32 JH
 315 12/12/32 JH
 316 01/01/33 JH
 317 02/01/33 JH
 318 03/01/33 JH
 319 04/01/33 JH
 320 05/01/33 JH
 321 06/01/33 JH
 322 07/01/33 JH
 323 08/01/33 JH
 324 09/01/33 JH
 325 10/01/33 JH
 326 11/01/33 JH
 327 12/01/33 JH
 328 01/02/34 JH
 329 02/02/34 JH
 330 03/02/34 JH
 331 04/02/34 JH
 332 05/02/34 JH
 333 06/02/34 JH
 334 07/02/34 JH
 335 08/02/34 JH
 336 09/02/34 JH
 337 10/02/34 JH
 338 11/02/34 JH
 339 12/02/34 JH
 340 01/03/35 JH
 341 02/03/35 JH
 342 03/03/35 JH
 343 04/03/35 JH
 344 05/03/35 JH
 345 06/03/35 JH
 346 07/03/35 JH
 347 08/03/35 JH
 348 09/03/35 JH
 349 10/03/35 JH
 350 11/03/35 JH
 351 12/03/35 JH
 352 01/04/36 JH
 353 02/04/36 JH
 354 03/04/36 JH
 355 04/04/36 JH
 356 05/04/36 JH
 357 06/04/36 JH
 358 07/04/36 JH
 359 08/04/36 JH
 360 09/04/36 JH
 361 10/04/36 JH
 362 11/04/36 JH
 363 12/04/36 JH
 364 01/05/37 JH
 365 02/05/37 JH
 366 03/05/37 JH
 367 04/05/37 JH
 368 05/05/37 JH
 369 06/05/37 JH
 370 07/05/37 JH
 371 08/05/37 JH
 372 09/05/37 JH
 373 10/05/37 JH
 374 11/05/37 JH
 375 12/05/37 JH
 376 01/06/38 JH
 377 02/06/38 JH
 378 03/06/38 JH
 379 04/06/38 JH
 380 05/06/38 JH
 381 06/06/38 JH
 382 07/06/38 JH
 383 08/06/38 JH
 384 09/06/38 JH
 385 10/06/38 JH
 386 11/06/38 JH
 387 12/06/38 JH
 388 01/07/39 JH
 389 02/07/39 JH
 390 03/07/39 JH
 391 04/07/39 JH
 392 05/07/39 JH
 393 06/07/39 JH
 394 07/07/39 JH
 395 08/07/39 JH
 396 09/07/39 JH
 397 10/07/39 JH
 398 11/07/39 JH
 399 12/07/39 JH
 400 01/08/40 JH
 401 02/08/40 JH
 402 03/08/40 JH
 403 04/08/40 JH
 404 05/08/40 JH
 405 06/08/40 JH
 406 07/08/40 JH
 407 08/08/40 JH
 408 09/08/40 JH
 409 10/08/40 JH
 410 11/08/40 JH
 411 12/08/40 JH
 412 01/09/41 JH
 413 02/09/41 JH
 414 03/09/41 JH
 415 04/09/41 JH
 416 05/09/41 JH
 417 06/09/41 JH
 418 07/09/41 JH
 419 08/09/41 JH
 420 09/09/41 JH
 421 10/09/41 JH
 422 11/09/41 JH
 423 12/09/41 JH
 424 01/10/42 JH
 425 02/10/42 JH
 426 03/10/42 JH
 427 04/10/42 JH
 428 05/10/42 JH
 429 06/10/42 JH
 430 07/10/42 JH
 431 08/10/42 JH
 432 09/10/42 JH
 433 10/10/42 JH
 434 11/10/42 JH
 435 12/10/42 JH
 436 01/11/43 JH
 437 02/11/43 JH
 438 03/11/43 JH
 439 04/11/43 JH
 440 05/11/43 JH
 441 06/11/43 JH
 442 07/11/43 JH
 443 08/11/43 JH
 444 09/11/43 JH
 445 10/11/43 JH
 446 11/11/43 JH
 447 12/11/43 JH
 448 01/12/44 JH
 449 02/12/44 JH
 450 03/12/44 JH
 451 04/12/44 JH
 452 05/12/44 JH
 453 06/12/44 JH
 454 07/12/44 JH
 455 08/12/44 JH
 456 09/12/44 JH
 457 10/12/44 JH
 458 11/12/44 JH
 459 12/12/44 JH
 460 01/01/45 JH
 461 02/01/45 JH
 462 03/01/45 JH
 463 04/01/45 JH
 464 05/01/45 JH
 465 06/01/45 JH
 466 07/01/45 JH
 467 08/01/45 JH
 468 09/01/45 JH
 469 10/01/45 JH
 470 11/01/45 JH
 471 12/01/45 JH
 472 01/02/46 JH
 473 02/02/46 JH
 474 03/02/46 JH
 475 04/02/46 JH
 476 05/02/46 JH
 477 06/02/46 JH
 478 07/02/46 JH
 479 08/02/46 JH
 480 09/02/46 JH
 481 10/02/46 JH
 482 11/02/46 JH
 483 12/02/46 JH
 484 01/03/47 JH
 485 02/03/47 JH
 486 03/03/47 JH
 487 04/03/47 JH
 488 05/03/47 JH
 489 06/03/47 JH
 490 07/03/47 JH
 491 08/03/47 JH
 492 09/03/47 JH
 493 10/03/47 JH
 494 11/03/47 JH
 495 12/03/47 JH
 496 01/04/48 JH
 497 02/04/48 JH
 498 03/04/48 JH
 499 04/04/48 JH
 500 05/04/48 JH
 501 06/04/48 JH
 502 07/04/48 JH
 503 08/04/48 JH
 504 09/04/48 JH
 505 10/04/48 JH
 506 11/04/48 JH
 507 12/04/48 JH
 508 01/05/49 JH
 509 02/05/49 JH
 510 03/05/49 JH
 511 04/05/49 JH
 512 05/05/49 JH
 513 06/05/49 JH
 514 07/05/49 JH
 515 08/05/49 JH
 516 09/05/49 JH
 517 10/05/49 JH
 518 11/05/49 JH
 519 12/05/49 JH
 520 01/06/50 JH
 521 02/06/50 JH
 522 03/06/50 JH
 523 04/06/50 JH
 524 05/06/50 JH
 525 06/06/50 JH
 526 07/06/50 JH
 527 08/06/50 JH
 528 09/06/50 JH
 529 10/06/50 JH
 530 11/06/50 JH
 531 12/06/50 JH
 532 01/07/51 JH
 533 02/07/51 JH
 534 03/07/51 JH
 535 04/07/51 JH
 536 05/07/51 JH
 537 06/07/51 JH
 538 07/07/51 JH
 539 08/07/51 JH
 540 09/07/51 JH
 541 10/07/51 JH
 542 11/07/51 JH
 543 12/07/51 JH
 544 01/08/52 JH
 545 02/08/52 JH
 546 03/08/52 JH
 547 04/08/52 JH
 548 05/08/52 JH
 549 06/08/52 JH
 550 07/08/52 JH
 551 08/08/52 JH
 552 09/08/52 JH
 553 10/08/52 JH
 554 11/08/52 JH
 555 12/08/52 JH
 556 01/09/53 JH
 557 02/09/53 JH
 558 03/09/53 JH
 559 04/09/53 JH
 560 05/09/53 JH
 561 06/09/53 JH
 562 07/09/53 JH
 563 08/09/53 JH
 564 09/09/53 JH
 565 10/09/53 JH
 566 11/09/53 JH
 567 12/09/53 JH
 568 01/10/54 JH
 569 02/10/54 JH
 570 03/10/54 JH
 571 04/10/54 JH
 572 05/10/54 JH
 573 06/10/54 JH
 574 07/10/54 JH
 575 08/10/54 JH
 576 09/10/54 JH
 577 10/10/54 JH
 578 11/10/54 JH
 579 12/10/54 JH
 580 01/11/55 JH
 581 02/11/55 JH
 582 03/11/55 JH
 583 04/11/55 JH
 584 05/11/55 JH
 585 06/11/55 JH
 586 07/11/55 JH
 587 08/11/55 JH
 588 09/11/55 JH
 589 10/11/55 JH
 590 11/11/55 JH
 591 12/11/55 JH
 592 01/12/56 JH
 593 02/12/56 JH
 594 03/12/56 JH
 595 04/12/56 JH
 596 05/12/56 JH
 597 06/12/56 JH
 598 07/12/56 JH
 599 08/12/56 JH
 600 09/12/56 JH
 601 10/12/56 JH
 602 11/12/56 JH
 603 12/12/56 JH
 604 01/01/57 JH
 605 02/01/57 JH
 606 03/01/57 JH
 607 04/01/57 JH
 608 05/01/57 JH
 609 06/01/57 JH
 610 07/01/57 JH
 611 08/01/57 JH
 612 09/01/57 JH
 613 10/01/57 JH
 614 11/01/57 JH
 615 12/01/57 JH
 616 01/02/58 JH
 617 02/02/58 JH
 618 03/02/58 JH
 619 04/02/58 JH
 620 05/02/58 JH
 621 06/02/58 JH
 622 07/02/58 JH
 623 08/02/58 JH
 624 09/02/58 JH
 625 10/02/58 JH
 626 11/02/58 JH
 627 12/02/58 JH
 628 01/03/59 JH
 629 02/03/59 JH
 630 03/03/59 JH

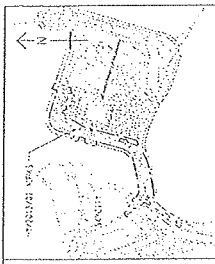

LOCATION PLAN
SCALE: 1:50,000

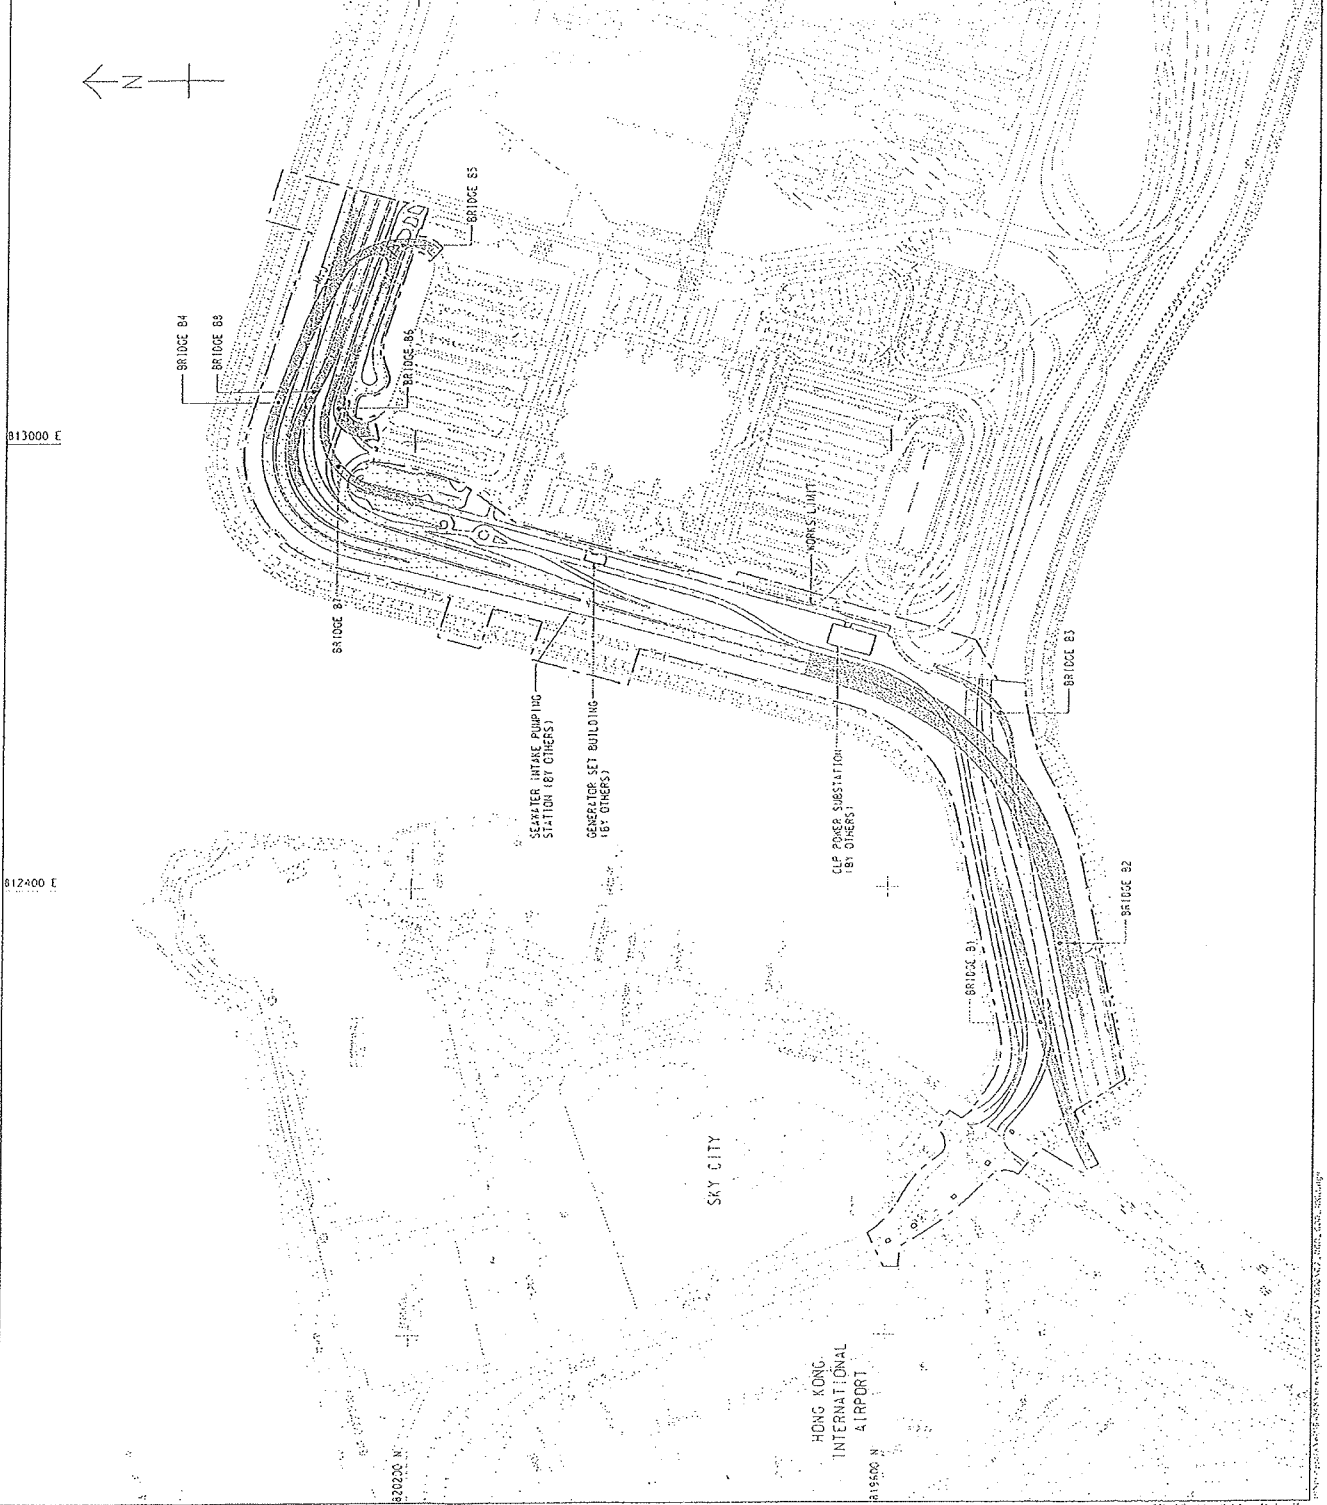

DATE	DESCRIPTION
12/11/03	ISSUE DRAWING
12/11/03	APPROVAL
12/11/03	REVISION


DESIGNED BY: AECOM
 DRAWN BY: AECOM
 CHECKED BY: AECOM
 APPROVED BY: AECOM

GENERAL ARRANGEMENT

AECOM
 Robert Sisk-Hubbard + Partners
 8000 RAYBOLD AVENUE, SUITE 100
 HOUSTON, TEXAS 77054

Aedas
 PROJECT NO. 60191043/C2/000/000/1003
 SHEET NO. 1 OF 1
 DATE: 11/11/2003
 SCALE: 1:50,000
 PROJECT: SKY CITY
 DRAWN BY: AECOM
 CHECKED BY: AECOM
 APPROVED BY: AECOM

THIS DOCUMENT IS THE PROPERTY OF AECOM AND IS NOT TO BE REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS, ELECTRONIC OR MECHANICAL, WITHOUT THE WRITTEN PERMISSION OF AECOM.

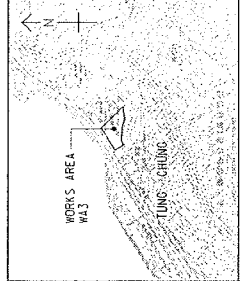

LOCATION PLAN
SCALE 1 : 25000

- NOTES:**
1. COORDINATES ARE RELATED TO HONG KONG MRFIC GRID 1980/11.
 2. DIMENSIONS ARE IN METRES UNLESS OTHERWISE SPECIFIED.
- LEGEND:**
- WORKS AREA BOUNDARY
 - PORTION 3.1
 - PORTION 3.2
 - PORTION 3.3
 - PORTION 3.4
 - PORTION 3.5
 - PORTION 3.6
 - PORTION 3.7
 - PORTION 3.8
 - PORTION 3.9

DESIGNER	HA
DATE	16/04/13
PROJECT	WORKS AREA WA3
SCALE	1:25000
PROJECT NO.	60191048/C2/000/C00/1041
PROJECT NAME	WORKS AREA WA3
PROJECT LOCATION	TUNG CHUNG
PROJECT DESCRIPTION	WORKS AREA WA3


WORKS AREA WA3

AECOM
Rogers Stirk Harbour + Partners
BUREAU HAPOLD
ATKINS
ADI

Aedas

DRGNO: 60191048/C2/000/C00/1041
PROJECT NO.: 60191048/C2/000/C00/1041
PROJECT NAME: WORKS AREA WA3
PROJECT LOCATION: TUNG CHUNG
SCALE: 1:25000
DATE: 16/04/13
METRES

© COPYRIGHT RESERVED

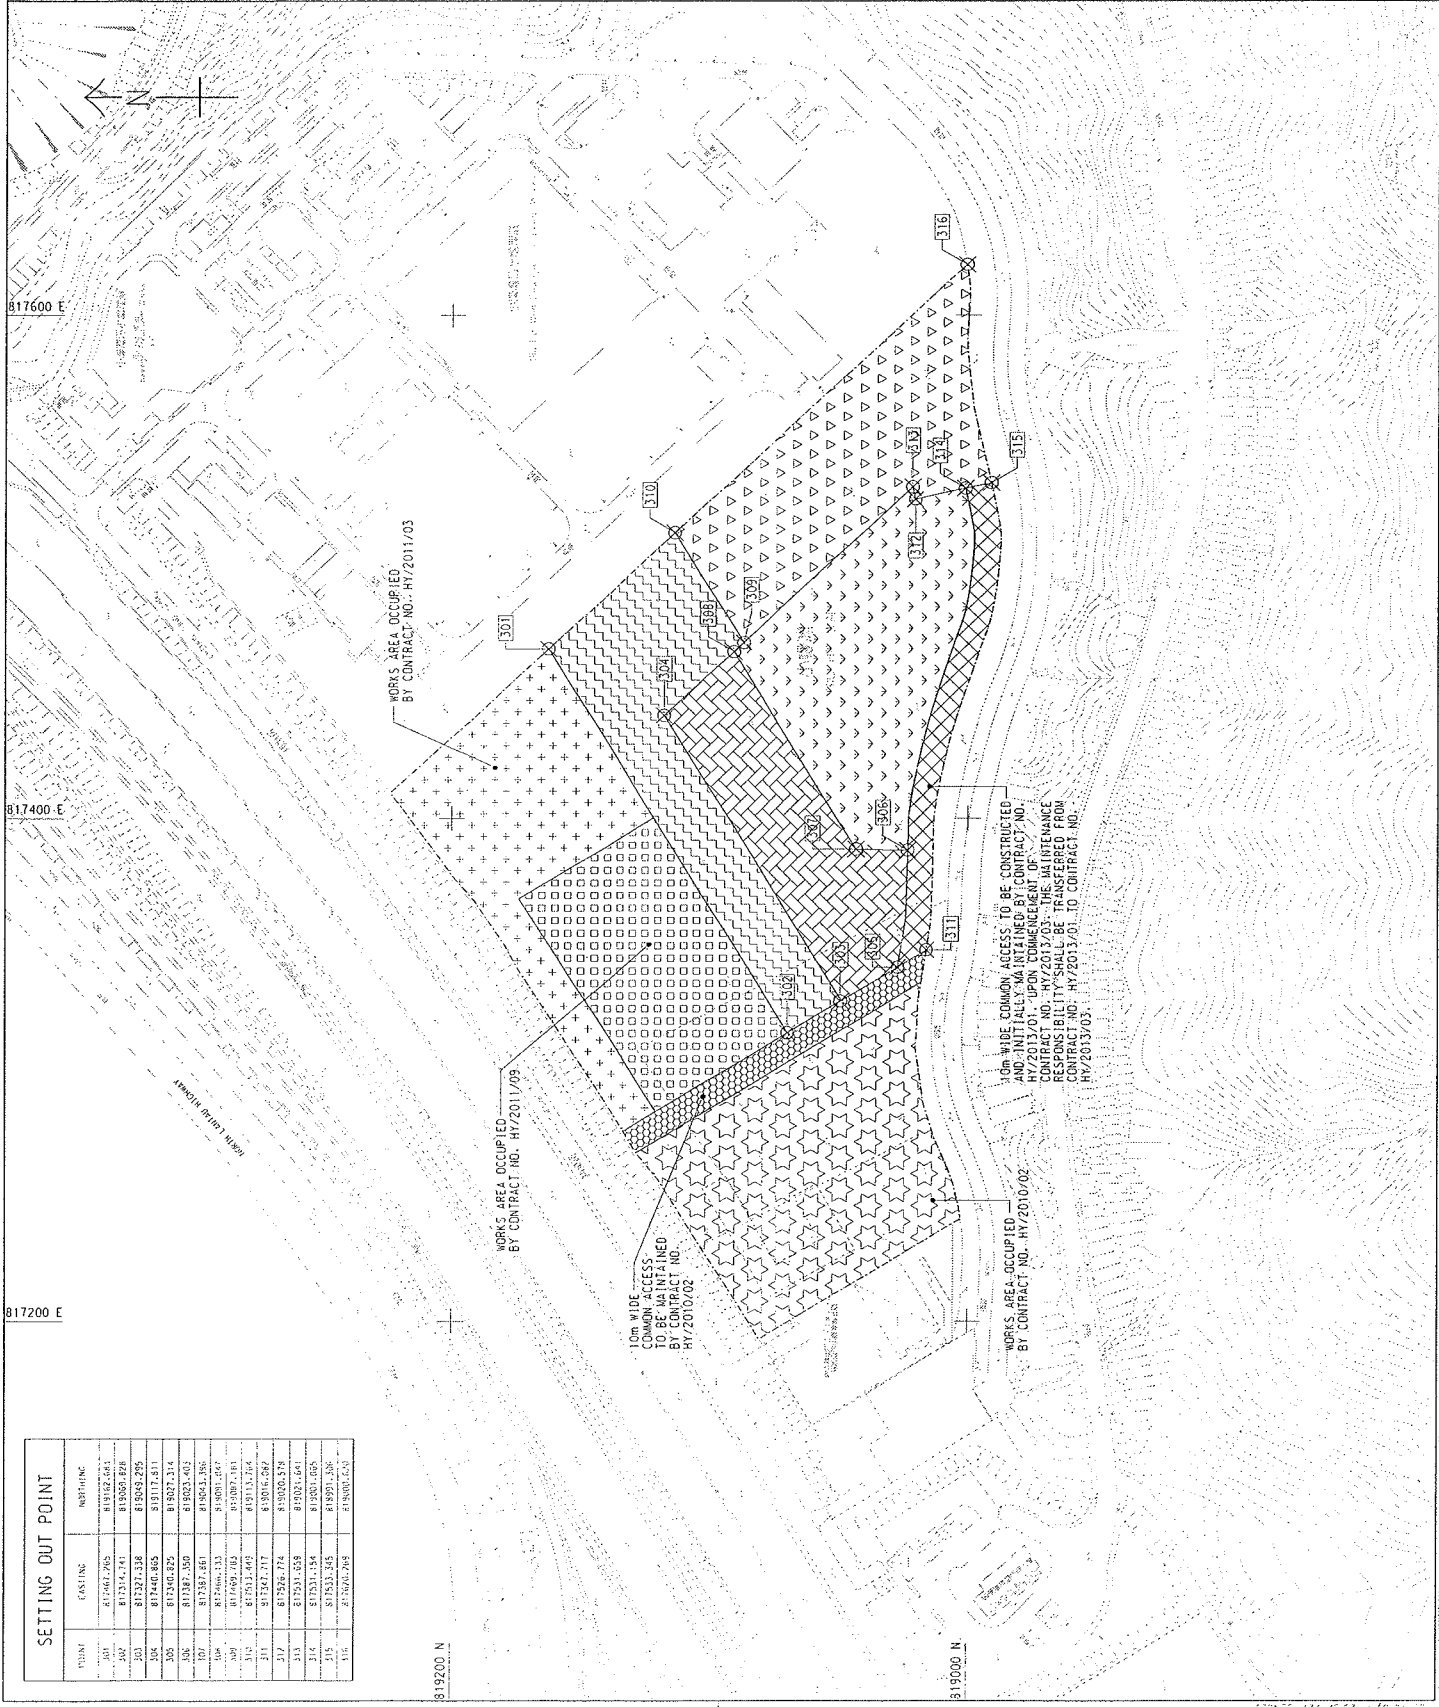


POINT	EASTING	NORTHING
1	817461.205	819182.464
2	817574.741	819305.828
3	817521.118	819291.275
4	817440.885	819177.811
5	817506.275	819077.314
6	817387.050	819023.403
7	817387.050	819023.403
8	817387.050	819023.403
9	817387.050	819023.403
10	817387.050	819023.403
11	817387.050	819023.403
12	817387.050	819023.403
13	817387.050	819023.403
14	817387.050	819023.403
15	817387.050	819023.403
16	817387.050	819023.403
17	817387.050	819023.403
18	817387.050	819023.403
19	817387.050	819023.403
20	817387.050	819023.403
21	817387.050	819023.403
22	817387.050	819023.403
23	817387.050	819023.403
24	817387.050	819023.403
25	817387.050	819023.403
26	817387.050	819023.403
27	817387.050	819023.403
28	817387.050	819023.403
29	817387.050	819023.403
30	817387.050	819023.403
31	817387.050	819023.403
32	817387.050	819023.403
33	817387.050	819023.403
34	817387.050	819023.403
35	817387.050	819023.403
36	817387.050	819023.403
37	817387.050	819023.403
38	817387.050	819023.403
39	817387.050	819023.403
40	817387.050	819023.403
41	817387.050	819023.403
42	817387.050	819023.403
43	817387.050	819023.403
44	817387.050	819023.403
45	817387.050	819023.403
46	817387.050	819023.403
47	817387.050	819023.403
48	817387.050	819023.403
49	817387.050	819023.403
50	817387.050	819023.403



Appendix B

Project Organization for Environmental Works

Appendix B Project Organization for Environmental Works

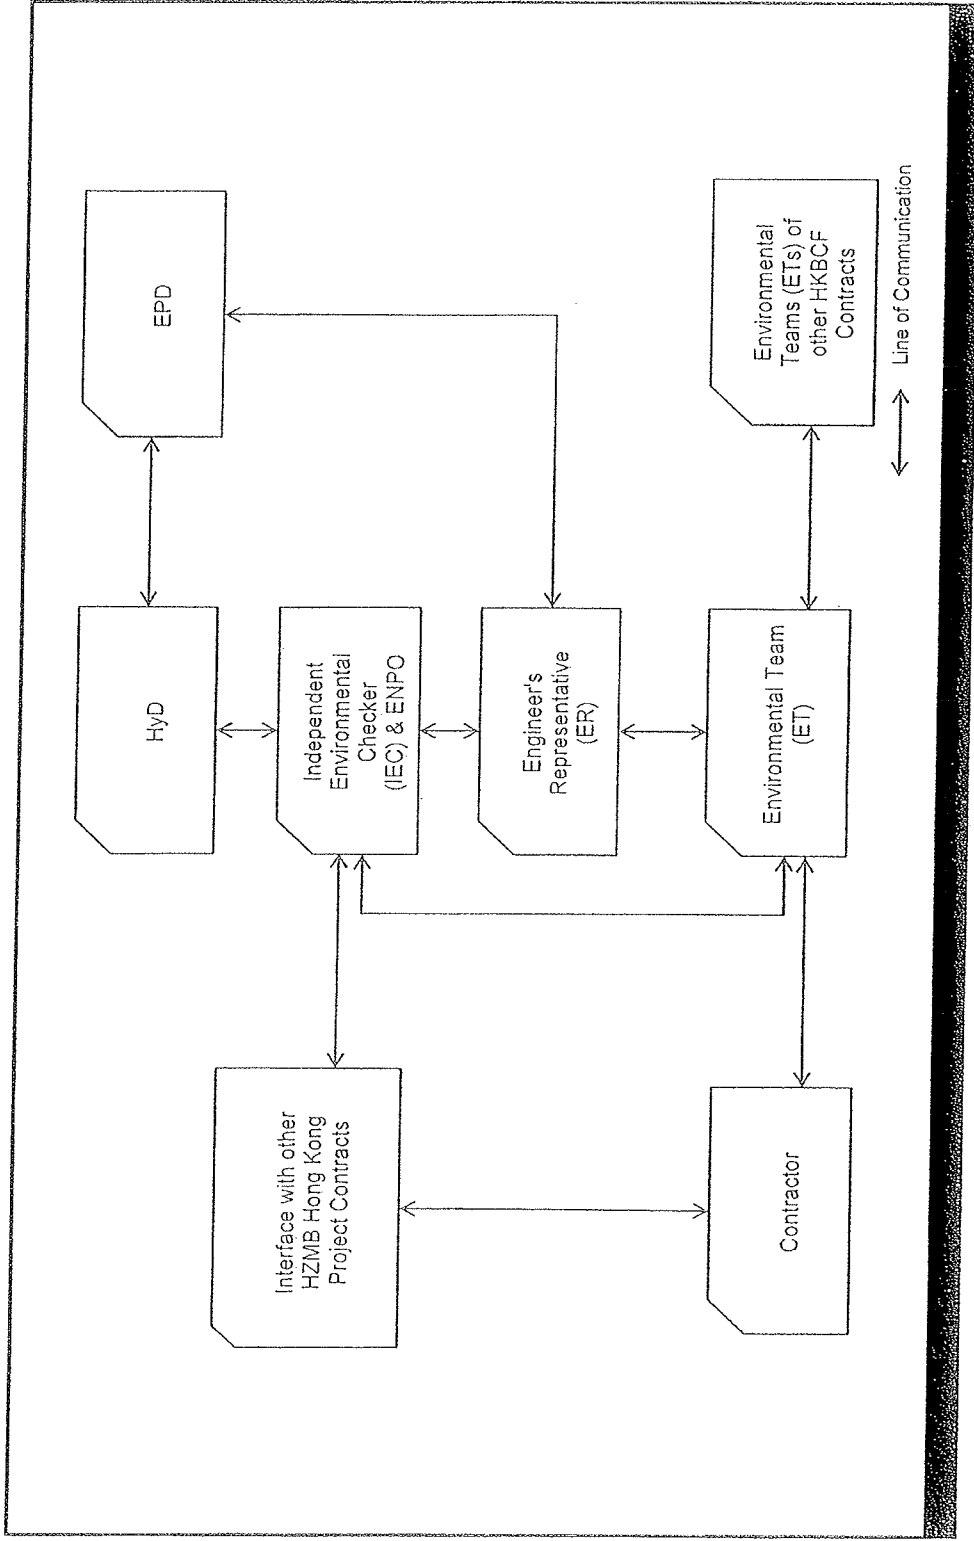


HONG KONG - ZHUHAI - MACAO BRIDGE
 HONG KONG BOUNDARY CROSSING FACILITIES
 --Infrastructures Works Stage I (Western Portion)



Appendix C

Construction Programme

HKBCF Infrastructure (Western Portion) - Monthly Progress 08 - Three Month Rolling Programme

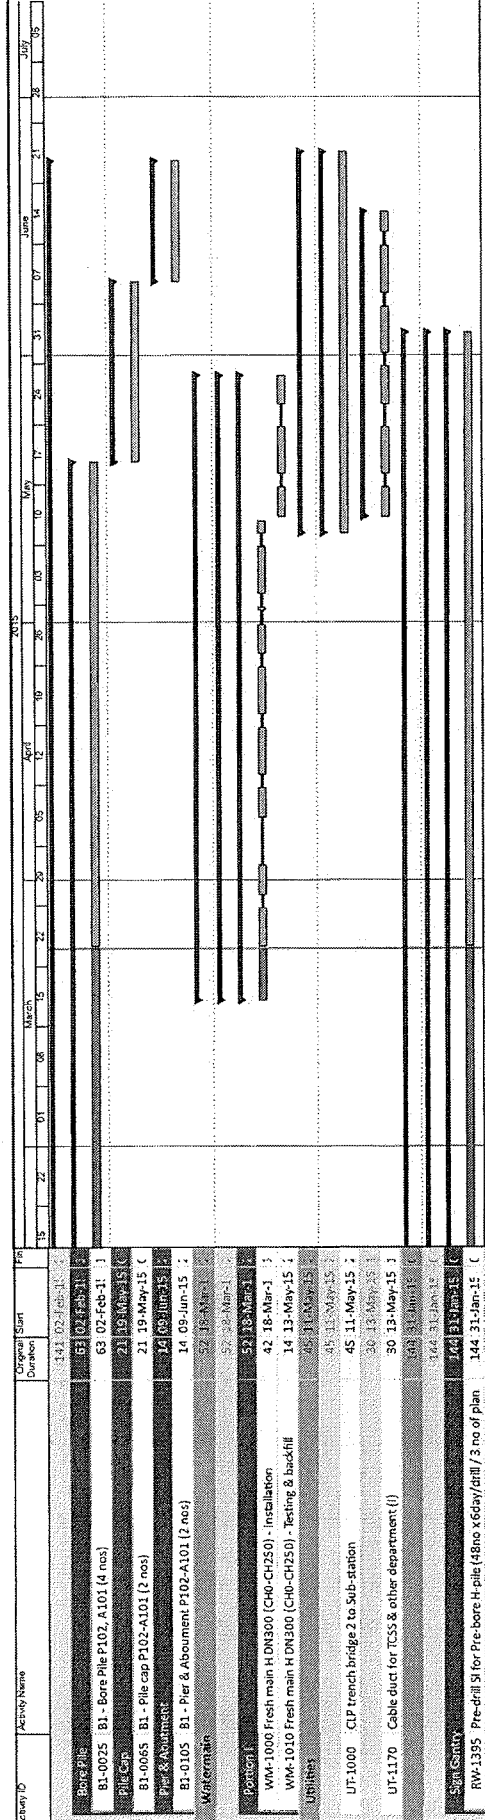

Summary	144.31	144.31	144.31
Remaining Level of Effort	0.00	0.00	0.00
Actual Level of Effort	0.00	0.00	0.00
Actual Work	0.00	0.00	0.00
Remaining Work	0.00	0.00	0.00
Critical Remaining Work	0.00	0.00	0.00
Milestone	0.00	0.00	0.00
Date	24-Mar-15		
Revision	monthly Report No. 8		
Checked			
Approved			



Appendix D

Event and Action Plan

Event/Action Plan for Air Quality

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform IEC and ER; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method. 	<ol style="list-style-type: none"> 1. Notify Contractor. 	<ol style="list-style-type: none"> 1. Rectify any unacceptable practice; 2. Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC and ER; 3. Advise the ER on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and ER; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> 1. Submit proposals for remedial to ER within 3 working days of notification; 2. Implement the agreed proposals; 3. Amend proposal if appropriate.

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
LIMIT LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> 1. Identify source, investigate the causes of exceedance and propose remedial measures; 2. Inform ER, Contractor and EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> 1. Notify IEC, ER, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.

Event / Action Plan for Construction Noise Monitoring

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
Action Level	<ol style="list-style-type: none"> 1. Notify IEC and Contractor; 2. Identify source, investigate the causes of exceedance and propose remedial measures; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the Contractor and formulate remedial measures; 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the analysed results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC; 2. Implement noise mitigation proposals.
Limit Level	<ol style="list-style-type: none"> 1. Inform IEC, ER, EPD and Contractor; 2. Identify source; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, ER and EPD the causes and actions taken for the exceedances; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.



Appendix E

Waste Flow Table



Monthly Summary Waste Flow Table for 2015 (year)

Name of Person completing the record: Selena YANG / ES

Project : Hong Kong – Zhuhai – Macao Bridge, Hong Kong Crossing Boundary Facilities – Infrastructure Works Stage I (Western Portion)

Contract No.: HY/2013/02

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Wastes Generated Monthly					
	Total Quantity Generated (in '000m ³)	Hard Rock and Large Broken Concrete (see Note 1) (in '000m ³)	Reused in the Contract (in '000m ³)	Reused in other Projects (in '000m ³)	Disposed as Public Fill (in '000m ³)	Imported Fill (in '000m ³)	Metals (in '000 kg)	Paper/ cardboard packaging (in '000kg)	Plastics (see Note 2) (in '000kg)	Chemical Waste (see Note 4) (in '000kg)	Others, e.g. general refuse (see Note 3) (in '000 m ³)	
Jan	0	0	0	0	0	0	0	0.048	0	0	0	
Feb	0	0	0	0	0	0	0	0	0	0	0	
Mar	0	0	0	0	0	0	0	0	3.206	0	0	
Apr												
May												
Jun												
Sub-total	0	0	0	0	0	0	0	0.048	3.206	0	0	
Jul												
Aug												
Sep												
Oct												
Nov												
Dec												
Total	0	0	0	0	0	0	0	0.048	3.206	0	0	

Notes: (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.

(2) Plastics refer to plastic bottles/containers, plastic sheets/ foam from packaging materials.

(3) Broken concrete for recycling into aggregates.



Appendix F

Environmental Licenses and Permits



Environmental Licenses and Permits

Item No.	Type of Permit / Licence	Reference No.	Application Date	Date of Issue	Date of Expiry	Remark
1	Environmental Permit under EIAO	EP-353/2009/H	16 Jan 2015	19 Jan 2015	NA	Issued
2	Construction Dust Notification (Western Portion)	Acknowledge Receipt: 377883	5 Aug 2014	11 Aug 2014	NA	Notified
3	Construction Dust Notification (Works Area WA3)	Acknowledge Receipt: 377884	5 Aug 2014	18 Aug 2014	NA	Notified
4	Construction Waste Disposal Account	Billing Account No.: 7020516	5 Aug 2014	15 Aug 2014	NA	Account approved
5	Registration as a Chemical Waste Producer (Works Area WA3)	Waste Producer Number (WPN): 5213-961-C1186-23	1 Sep 2014	17 Oct 2014	NA	Registration completed
6	Discharge License under WPCO (Works Area WA3)	License No.: WT00020194-2014	21 Aug 2014	27 Oct 2014	31 Oct 2019	License approved
7	Discharge License under WPCO (Western Portion)	License No.: WT00020597-2014	25 Sep 2014	16 Mar 2015	31 Mar 2020	License approved
8	Registration as a Chemical Waste Producer (Western Portion)	Waste Producer Number (WPN): 5213-961-C1186-27	20 Oct 2014	24 Nov 2014	NA	Registration completed
9	Construction Noise Permit under NCO for HKBCF (Western Portion) - Portion D	License No.: GW – RS0072 - 15	6 Jan 2015	22 Jan 2015	21 Jul 2015	Permit was surrendered with effective on 12 Feb 2015 and superseded by GW – RS0128-15
10	Construction Noise Permit under NCO for HKBCF (Western Portion) – Portion D & H	License No.: GW-RS0128-15	26 Jan 2015	12 Feb 2015	8 Aug 2015	Permit Approved



Appendix G

Implementation Schedule for Environmental Mitigation Measures (EMIS)

Environmental Mitigation Implementation Schedule – Hong Kong Boundary Crossing Facilities (Superstructures and Infrastructures)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
<i>Air Quality</i>							
S5.5.6.1	A1	<p>1) The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation</p> <p>2) Proper watering of exposed spoil should be undertaken throughout the construction phase.</p> <ul style="list-style-type: none"> Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading. Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads. A stockpile of dusty material should not be extend beyond the pedestrian barriers, fencing or traffic cones. The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle; Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 	<p>Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p> <p>Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p>	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are $500\mu\text{g}/\text{m}^3$ and $260\mu\text{g}/\text{m}^3$, respectively)
S5.5.6.2	A2	<ul style="list-style-type: none"> Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; 	<p>Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p>	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are $500\mu\text{g}/\text{m}^3$ and $260\mu\text{g}/\text{m}^3$, respectively)

EIA Ref.	EM&A Log/Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S5.5.6.2	A2	<p>Recommended Mitigation Measures</p> <ul style="list-style-type: none"> • When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period; • The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; • Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical continuously; • Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; • Where a scaffolding is erected around the perimeter of a building under construction effective dust screens, sheeting or netting should be provided to enclose the scaffolding from the ground floor level of the building, or a canopy should be provided from the first floor level up to the highest level of the scaffolding; • Any skip hoist for material transport should be totally enclosed by impervious sheeting; • Every stock of more than 20 bags of cement or dry pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 2 sides. 	<p>Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.</p>	<p>Contractor</p>	<p>All construction sites</p>	<p>Construction stage</p>	<p>To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500μg/m³ and 260μg/m³, respectively)</p>

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S5.5.6.2	A2	<ul style="list-style-type: none"> Cement or dry PFA delivered in bulk should be stored in a closed silo fitted with an audible high level alarm which is interlocked with the material filling line and no overfilling is allowed; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system; and Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabiliser within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	All construction sites	Construction stage	To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500 $\mu\text{g}/\text{m}^3$ and 260 $\mu\text{g}/\text{m}^3$, respectively)
S5.5.6.3	A3	3) The Contractor should undertake proper watering on all exposed spoil (with at least 8 times per day) throughout the construction phase.	Control construction dust	Contractor	All construction sites	Construction stage	To control the dust impact
S5.5.6.4	A4	4) Engineer to incorporate the controlled measures into the Particular Specification (PS) for the civil work. The PS should also draw the contractor's attention to the relevant latest Practice Notes issued by EPD.	Control construction dust	Engineer	All construction sites	Design Stage	Air Pollution Control (Construction Dust) Regulation
S5.5.6.4	A5	5) Implement regular dust monitoring under EM&A programme during the construction stage.	Monitor the 24 hr and 1hr TSP levels at the representative dust monitoring stations to ensure compliance with relevant criteria throughout the construction period.	Contractor	Selected representative dust monitoring station	Construction stage	<ul style="list-style-type: none"> Air Pollution Control (Construction Dust) Regulation To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500$\mu\text{g}/\text{m}^3$ and 260$\mu\text{g}/\text{m}^3$, respectively).

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S5.5.7.1	A6	<p>The following mitigation measures should be adopted to prevent fugitive dust emissions from concrete batching plant:</p> <ul style="list-style-type: none"> • Loading, unloading, handling, transfer or storage of any dusty materials should be carried out in totally enclosed system; • All dust-laden air or waste gas generated by the process operations should be properly extracted and vented to fabric filtering system to meet the emission limits for TSP; • Vents for all silos and cement/pulverised fuel ash (PFA) weighing scale should be fitted with fabric filtering system; • The materials which may generate airborne dusty emissions should be wetted by water spray system; • All receiving hoppers should be enclosed on three sides up to 3m above unloading point; • All conveyor transfer points should be totally enclosed; • All access and route roads within the premises should be paved and wetted; and • Vehicle cleaning facilities should be provided and used by all concrete trucks before leaving the premises to wash off any dust on the wheels and/or body. 	<p>Monitor the 24-hr and 1-hr TSP levels at the representative dust monitoring stations to ensure compliance with relevant criteria throughout the construction period.</p>	Contractor	Selected representative dust monitoring station	Construction stage	<ul style="list-style-type: none"> • Air Pollution Control (Construction Dust) Regulation • To control the dust impact to within the HKAQO and TM-EIA criteria (Ref. 1-hr and 24hr TSP levels are 500 $\mu\text{g}/\text{m}^3$ and 260 $\mu\text{g}/\text{m}^3$, respectively)
S5.5.2.7	A7	<p>The following mitigation measures should be adopted to prevent fugitive dust emissions at barging point:</p> <ul style="list-style-type: none"> • All road surface within the barging facilities will be paved; • Dust enclosures will be provided for the loading ramp; • Vehicles will be required to pass through designated wheels wash facilities; and • Continuous water spray at the loading points. 	Control construction dust	Contractor	All construction sites	Construction stage	<ul style="list-style-type: none"> • Air Pollution Control (Construction Dust) Regulation

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Construction Noise (Air borne)							
S6.4.10	N1	<p>1) Use of good site practices to limit noise emissions by considering the following:</p> <ul style="list-style-type: none"> only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; mobile plant should be sited as far away from NSRs as possible and practicable; material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities. 	Control construction airborne noise by means of good site practices	Contractor	All construction sites	Construction stage	Noise Control Ordinance
S6.4.11	N2	<p>2) Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of the hoardings shall be properly maintained throughout the construction period.</p>	Reduce the construction noise levels at low-level zone of NSRs through partial screening.	Contractor	All construction sites	Construction stage	<ul style="list-style-type: none"> Noise Control Ordinance Annex 5, TM-EIA
S6.4.12	N3	<p>3) Install movable noise barriers (typically density @14kg/m³), acoustic mat or full enclosure close to noisy plants including air compressor, generators, saw.</p>	Screen the noisy plant items to be used at all construction sites	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	<ul style="list-style-type: none"> Noise Control Ordinance Annex 5, TM-EIA 75dB(A) for residential premises The movable barrier should achieve at least 5dB(A) and the full enclosure should be designed to achieve 10dB(A)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S6.4.13	N4	4) Select "Quiet plants" which comply with the BS 5228 Part 1 or TM standards.	Reduce the noise levels of plant items	Contractor	For plant items listed in Appendix 6D of the EIA report at all construction sites	Construction stage	• Noise Control Ordinance & its TM • Annex 5, TM-EIA
S6.4.14	N5	5) Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Noise Control Ordinance • Annex 5, TM-EIA
S5.1	N6	6) Implement a noise monitoring under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected representative noise monitoring station	Construction stage	• Noise Control Ordinance • Annex 5, TM-EIA • 75dB(A) for residential premises
Operational Noise							
S6.8.4	N7	1) The maximum allowable Sound Power Level (SWLs) for the following shall be compiled with during the selection of facility equipment. • Sewage Treatment Plant; • Electric Substation; • Seawater Intake; and • Ventilation Building for the Scenic Hill Tunnel.	Ensure the compliance of operational noise at the sensitive receivers	Engineer	Fixed noise sources	Design stage	• NCO and its TM • TM-EIA
	N8	2) The Engineer shall incorporate the requirements for noise commissioning of fixed plant noise sources in the Particular Specification.	Ensure compliance with relevant requirements	Engineer	Fixed noise sources	Design stage	• NCO and its TM • TM-EIA
Sediment							
S7.3	S1	1) The requirements as recommended in ETWB TC 34/2002 Management of Dredged/Excavated Sediment shall be included in the Particular Specification as appropriate.	Develop sediment disposal arrangement	Engineer	All construction sites	Design stage	• Waste Disposal Ordinance • ETWB TC 34/2002

EIA Ref:	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S8.3.8	WMM1	<p><u>Construction and Demolition Material</u></p> <p>The following mitigation measures should be implemented in handling the waste:</p> <ul style="list-style-type: none"> • Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; • Carry out on-site sorting; • Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; • Adopt 'Selective Demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; • Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and • Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. • In addition, disposal of the C&D materials onto any sensitive locations such as agricultural lands, etc. should be avoided. The Contractor shall propose the final disposal sites to the Project Proponent and get its approval before implementation 	<p>Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal</p>	Contractor	All construction sites	Construction stage	<ul style="list-style-type: none"> • Land (Miscellaneous Provisions) Ordinance • Waste Disposal Ordinance • ETWB TC 19/2005

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S8.3.9-S8.3.11	WM2	<p><u>C&D Waste</u></p> <ul style="list-style-type: none"> Standard formwork or pre-fabrication should be used as far as practicable in order to minimise the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage. The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage. 	<p>Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal</p>	Contractor	All construction sites	Construction stage	<ul style="list-style-type: none"> Land (Miscellaneous Provisions) Ordinance Waste Disposal Ordinance ETWB TC 19/2005
S8.2.12-S8.3.15	WM3	<p><u>Chemical Waste</u></p> <ul style="list-style-type: none"> Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; have a capacity of less than 450 liters unless the specification has been approved by the EPD; and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation. The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste; enclosed on at least 3 sides; have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20 % of the total volume of waste stored in that area, whichever is the greatest; have adequate ventilation; covered to prevent rainfall entering; and arranged so that incompatible materials are adequately separated. 	<p>Control the chemical waste and ensure proper storage, handling and disposal.</p>	Contractor	All construction sites	Construction stage	<ul style="list-style-type: none"> Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		<ul style="list-style-type: none"> Disposal of chemical waste should be via a licensed waste collector; be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers; or be to a reuser of the waste, under approval from the EPD. 					
S8.3.16	WM4	<p><u>Sewage</u></p> <ul style="list-style-type: none"> Adequate numbers of portable toilets should be provided for the workers. The portable toilets should be maintained in a state, which will not deter the workers from utilizing these portable toilets. Night soil should be collected by licensed collectors regularly. 	Proper handling of sewage from worker to avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance
S8.3.17	WM5	<p><u>General Refuse</u></p> <ul style="list-style-type: none"> General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes. A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminium cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible. Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. In addition, waste separation facilities for paper, aluminium cans, plastic bottles etc., should be provided. Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedure, including reduction, reuse and recycling of wastes. 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S8.4.3	WM6	<p>The requirements given in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes should be followed in handling of these chemical wastes. A trip-ticket system should be operated in accordance with the Waste Disposal (Chemical Waste) (General) Regulation to monitor all movements of chemical wastes which will be collected by a licensed collector to a licensed facility for final treatment and disposal.</p>	Minimize production of the waste	Operator	All logistic lots	Operational stage	Waste Disposal Ordinance

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S9.11.1.7	W2	<p><u>Water Quality (Construction Phase)</u></p> <p><u>Land Works</u></p> <p>General construction activities on land should also be governed by standard good working practice. Specific measures to be written into the works contracts should include:</p> <ul style="list-style-type: none"> wastewater from temporary site facilities should be controlled to prevent direct discharge to surface or marine waters; sewage effluent and discharges from on-site kitchen facilities shall be directed to Government sewer in accordance with the requirements of the WPCO or collected for disposal offsite. The use of soakaways shall be avoided; storm drainage shall be directed to storm drains via adequately designed sand/silt removal facilities such as sand traps, silt traps and sediment basins. Channels, earth bunds or sand bag barriers should be provided on site to properly direct stormwater to such silt removal facilities. Catchpits and perimeter channels should be constructed in advance of site formation works and earthworks; silt removal facilities, channels and manholes shall be maintained and any deposited silt and grit shall be removed regularly, including specifically at the onset of and after each rainstorm; temporary access roads should be surfaced with crushed stone or gravel; rainwater pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; measures should be taken to prevent the washout of construction materials, soil, silt or debris into any drainage system; open stockpiles of construction materials (e.g. aggregates and sand) on site should be covered with tarpaulin or similar fabric during rainstorms; manholes (including any newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system, and to prevent storm run-off from getting into foul sewers; discharges of surface run-off into foul sewers must always be prevented in order not to unduly overload the foul sewerage system; 	To control construction water quality	Contractor	Land-based works areas	Construction stage	TM-EIAO

EIA Ref.	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S9.11.1.7	W2	<ul style="list-style-type: none"> • all vehicles and plant should be cleaned before they leave the construction site to ensure that no earth, mud or debris is deposited by them on roads. A wheel washing bay should be provided at every site exit; • wheel wash overflow shall be directed to silt removal facilities before being discharged to the storm drain; • the section of construction road between the wheel washing bay and the public road should be surfaced with crushed stone or coarse gravel; • wastewater generated from concreting, plastering, internal decoration, cleaning work and other similar activities, shall be screened to remove large objects; • vehicle and plant servicing areas, vehicle wash bays and lubrication facilities shall be located under roofed areas. The drainage in these covered areas shall be connected to foul sewers via a petrol interceptor in accordance with the requirements of the WPCO or collected for off site disposal; • the contractors shall prepare an oil / chemical cleanup plan and ensure that leakages or spillages are contained and cleaned up immediately; • waste oil should be collected and stored for recycling or disposal, in accordance with the Waste Disposal Ordinance; • all fuel tanks and chemical storage areas should be provided with locks and be sited on sealed areas. The storage areas should be surrounded by bunds with a capacity equal to 110% of the storage capacity of the largest tank; and • surface run-off from bunded areas should pass through oil/grease traps prior to discharge to the stormwater system. 	To control construction water quality	Contractor	Land-based works areas	Construction stage	TM-EIAO

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Water Quality (Operation Phase)							
S9.8.3.15	W4	Upon completion of the development, stormwater drainage systems would be completed to collect stormwater generated from the whole area including new roads. Sewage generated from the development would be collected by the sewerage systems for delivery to sewage treatment plant at HKBCF. Additional mitigation measures would not be required.	Control water quality	Scheme designers	Stormwater infrastructure	Operational Stage	<ul style="list-style-type: none"> TM-water Water Pollution Control Ordinance
Ecology (Construction Phase)							
S10.7	E4	<ul style="list-style-type: none"> Watering to reduce dust generation; prevention of siltation of freshwater habitats; Site runoff should be desilted, to reduce the potential for suspended sediments, organics and other contaminants to enter streams and standing freshwater 	Prevent Sedimentation from Land-based works areas	Contractor	Land-based works areas	During construction	TM-Water
S10.7	E5	<ul style="list-style-type: none"> Good site practices, including strictly following the permitted works hours, using quieter machines where practicable, and avoiding excessive lightings during night time 	Prevent disturbance to terrestrial fauna and habitats	Contractor	Land-based works areas	During construction	
S10.7	E8	<ul style="list-style-type: none"> Control vessel speed Skipper training Predetermined and regular routes for working vessels; avoid Brother Islands. 	Minimise marine traffic disturbance on dolphins	Contractor	Marine traffic	During construction	
Ecology (Operation Phase)							
S10.7	E13	<ul style="list-style-type: none"> Install silt-grease trap in the drainage system collecting surface runoff 	Minimise impacts on marine ecology	Designer	Reclamation area	During construction	TM-Water
S10.7	E14	<ul style="list-style-type: none"> Maritime Oil Spill Response Plan (MOSRP); Contingency plan. 	Minimise impacts on marine ecology	Marine Department	HKBCF	During operation	
Fisheries							
S11.7	F4	<ul style="list-style-type: none"> Maritime Oil Spill Response Plan (MOSRP); Contingency plan. 	Minimise impacts on marine water quality impacts	Marine Department	HKBCF	During operation	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Landscape & Visual (Detailed Design Phase)							
S14.3.3.1	LV1	<p>General design measures include:</p> <ul style="list-style-type: none"> • Roadside planting and planting along the edge of the HKBCF Island is proposed; • Transplanting of mature trees in good health and amenity value where appropriate and reinstatement of areas disturbed during construction by compensatory hydro-seeding and planting; • Protection measures for the trees to be retained during construction activities; • Optimizing the sizes and spacing of the bridge columns; Fine-tuning the location of the bridge columns to avoid visually-sensitive locations; • Aesthetic design of the bridge form and its structural elements for HKLR, e.g. parapet, soffit, columns, lightings and so on; • Considering the decorative urban design elements for HKLR, e.g. decorative road lightings; • Maximizing new tree, shrub and other vegetation planting to compensate tree felled and vegetation removed; • Providing planting area around peripheral of HKBCF for tree planting screening effect; • Providing salt-tolerant native trees along the planter strip at affected seawall and newly reclaimed coastline; • For HKBCF, providing aesthetic architectural design on the related buildings (e.g. similar materials for PCB building facade to Airport buildings, roof planting and subtle materials for other facilities buildings and so on), and the related infrastructure (e.g. parapet planting and transparent cover for elevated footbridges) to provide harmonious atmosphere of the HKBCF; and 	Minimise visual & landscape impact	Detailed designer	HKBCF	Design Stage	

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S14.3.3.1	LV1	<p><i>Landscape & Visual (Detailed Design Phase)</i></p> <ul style="list-style-type: none"> • Fine-tuning the sizes of the structural members to minimize the bulkiness of buildings and adjustment of building arrangement to minimise disturbance to surrounding vegetation in the HKBCF. • For HKLR, Providing aesthetic design on the viaduct, tunnel portals, at grade roads and reclamation (e.g, subtle color tone and slim form for viaduct to minimize the bulkiness of the structure and to blend the viaduct better with the background environment featured form of tunnel portals, roadside planting along at-grade roads and landscape berm on & planting along edge of reclamation area) to beautify the HKLR alignment. 	Minimise visual & landscape impact	Detailed designer	HKBCF	Design Stage	

EIA Ref.	EIM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Landscape & Visual (Construction Phase)							
S14.3.3.	LV2	<p>Mitigate both Landscape and Visual Impacts</p> <p>G1. Grass-hydroseed bare soil surface and stock pile areas.</p> <p>G2. Add planting strip and automatic irrigation system if appropriate at some portions of bridge footbridge to screen bridge and traffic.</p> <p>G3. For HKLR, Providing aesthetic design on the viaduct, tunnel portals, at grade roads and reclamation (e.g. subtle color tone and slim form for viaduct to minimize the bulkiness of the structure and to blend the viaduct better with the background environment featured form of tunnel portals, roadside planting along at-grade roads and landscape berm on & planting along edge of reclamation area) to beautify the HKLR alignment.</p> <p>G4. For HKBCF, providing aesthetic architectural design on the related buildings (e.g. similar materials for PCB building facade to Airport buildings, roof planting and subtle materials for other facilities buildings and so on), and the related infrastructure (e.g. parapet planting and transparent cover for elevated footbridges) to provide harmonious atmosphere of the HKBCF</p> <p>G5. Vegetation reinstatement and upgrading to disturbed areas</p> <p>G6. Maximizing new tree shrub and other vegetation planting to compensate tree felled and vegetation removed</p> <p>G7. Providing planting area around peripheral of HKBCF for tree planting screening effect;</p> <p>G8. Plant salt-tolerant native and shrubs etc along the planter strip at affected seawall.</p> <p>G9. Reserve of loose natural granite rocks for re-use. Provide new coastline to adopt "natural-look" by means of using armour rocks in the form of natural rock materials and planting strip area accommodating screen buffer to enhance "natural-look" of the new coastline.</p>	Minimise visual & landscape impact	Contractor	HKBCF	Construction stage	

S14.3.3.3	LV3	Mitigate Visual Impacts V1. Minimize time for construction activities during construction period. V2. Provide screen hearing at the portion of the project site / works areas / storage areas near VSRs who have close low-level views to the Project during HKBCF construction.						
-----------	-----	--	--	--	--	--	--	--

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Landscape & Visual (Operation Phase)							
S14.3.3.3	LV4	Mitigate both Landscape and Visual Impacts G10. Provide proper planting maintenance on the new planting areas to enhance the aesthetic degree.	Minimise visual & landscape impact	Project Proponent	HKBCF	Operation stage	
		Mitigate Visual Impacts V3. Lighting design to minimize glare at night. Decorative road lighting to be considered during detailed design stage.					
EM&A							
S15.2.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual.	Control EM&A Performance	Project Proponent	All construction sites	Construction stage	<ul style="list-style-type: none"> EIAO Guidance Note No.4/2002 TM-EIAO
S15.5 - S15.6	EM2	<ol style="list-style-type: none"> 1) An Environmental Team needs to be employed as per the EM&A Manual. 2) Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures. 3) An environmental impact monitoring needs to be implementing by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with. 	Perform environmental monitoring & auditing	Contractor	All construction sites	Construction stage	<ul style="list-style-type: none"> EIAO Guidance Note No.4/2002 TM-EIAO



Appendix H

Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions



Statistics on Environmental Complaints, Notification of Summons and Successful Prosecutions

Reporting Period	Cumulative Statistics		
	Complaints	Notifications of summons	Successful prosecutions
This reporting period	0	0	0
From commencement date of construction to end of reporting month	0	0	0



Appendix I

Environmental Site Inspection Schedule



Contract No.: HY/2013/02
Hong Kong – Zhuhai – Macao Bridge
Hong Kong Boundary Crossing Facilities – Infrastructure Works Stage I
(Western Portion)

Schedule for Weekly Environmental Site Inspection

March 2015

Sun	Mon	Tue	Wed	Thu	Fri	Sat
1	2	3	4	5	6 Environmental Site Inspection	7
8	9	10 Environmental Site Inspection	11	12	13	14
15	16	17	18	19	20 Environmental Site Inspection	21
22	23	24 Environmental Site Inspection	25	26	27	28
29	30	31 Environmental Site Inspection				



Contract No.: HY/2013/02
Hong Kong – Zhuhai – Macao Bridge
Hong Kong Boundary Crossing Facilities – Infrastructure Works Stage I
(Western Portion)

Schedule for Weekly Environmental Site Inspection

April 2015

Sun	Mon	Tue	Wed	Thu	Fri	Sat
			1	2	3	4
5	6	7	8 Environmental Site Inspection	9	10	11
12	13	14	15	16	17 Environmental Site Inspection	18
19	20	21 Environmental Site Inspection	22	23	24	25
26	27	28 Environmental Site Inspection	29	30		