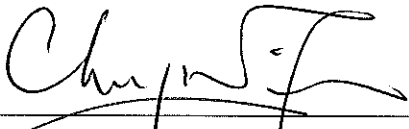


**China Harbour Engineering Company Limited**

Contract No. DC/2009/09  
Construction of Tai Po Sewage Treatment  
Works – Stage V Phase II B

**Monthly Environmental Monitoring  
and Audit Report for  
October 2010**

(Version 1.0)

Certified By   
(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties.

**CINOTECH CONSULTANTS LTD**  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong  
Tel: (852) 2151 2083 Fax: (852) 3107 1388  
Email: [info@cinotech.com.hk](mailto:info@cinotech.com.hk)

# TABLE OF CONTENTS

	Page
<b>EXECUTIVE SUMMARY .....</b>	<b>1</b>
Introduction .....	1
Environmental Monitoring and Audit Works .....	1
Environmental Licenses and Permits .....	1
Key Information in the Reporting Month.....	2
Future Key Issues .....	2
<b>1 INTRODUCTION.....</b>	<b>3</b>
Background.....	3
Construction Programme.....	4
Summary of EM&A Requirements .....	4
<b>2 AIR QUALITY MONITORING .....</b>	<b>6</b>
Monitoring Requirements.....	6
Monitoring Locations .....	6
Monitoring Equipment .....	6
Monitoring Parameters, Frequency and Duration .....	6
Monitoring Methodology and QA/QC Procedure .....	7
Results and Observations .....	8
<b>3 NOISE MONITORING.....</b>	<b>10</b>
Monitoring Requirements.....	10
Monitoring Locations .....	10
Monitoring Equipment .....	10
Monitoring Parameters, Frequency and Duration .....	10
Results and Observations .....	12
<b>4 LANDFILL GAS MONITORING.....</b>	<b>13</b>
Monitoring Requirements.....	13
Monitoring Parameters and Frequency.....	13
Monitoring Locations .....	13
Monitoring Equipment .....	13
Results .....	13
<b>5 ENVIRONMENTAL AUDIT.....</b>	<b>14</b>
Site Audits .....	14
Review of Environmental Monitoring Procedures.....	14
Status of Environmental Licensing and Permitting.....	14
Status of Waste Management .....	15
Implementation Status of Environmental Mitigation Measures.....	16
Summary of Exceedances.....	16
Implementation Status of Event Action Plans.....	16
Summary of Complaint and Prosecution.....	17
<b>6 FUTURE KEY ISSUES .....</b>	<b>17</b>
Monitoring Schedule for the Next Month .....	17
Construction Program for the Next Month.....	17
<b>7 CONCLUSIONS AND RECOMMENDATIONS.....</b>	<b>18</b>

Conclusions .....	18
Recommendations .....	18

## **LIST OF TABLES**

Table I	Summary Table for Events Recorded in the Reporting Month
Table II	Summary Table for Key Information in the Reporting Month
Table 1.1	Key Project Contacts
Table 2.1	Locations for Air Quality Monitoring
Table 2.2	Air Quality Monitoring Equipment
Table 2.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 2.4	Summary Table of Air Quality Monitoring Results during the reporting month
Table 3.1	Location of Noise Monitoring Station
Table 3.2	Noise Monitoring Equipment
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 3.4	Summary Table of Noise Monitoring Results during the Reporting Month
Table 4.1	Landfill Gas Monitoring Equipment
Table 5.1	Summary of Environmental Licensing and Permit Status
Table 5.2	Observations and Recommendations of Site Audit

## **LIST OF FIGURE**

Figure 1.1	Site Layout Plan
Figure 1.2	Locations of Air Quality and Noise Monitoring Stations
Figure 1.3	Landfill Gas Monitoring Area

## **LIST OF APPENDICES**

Appendix A	Action and Limit Levels
Appendix B	Copies of Calibration Certificates
Appendix C	Environmental Monitoring Schedules
Appendix D	1-hour TSP Monitoring Results and Graphical Presentations
Appendix E	24-hour TSP Monitoring Results and Graphical Presentations
Appendix F	Noise Monitoring Results and Graphical Presentations
Appendix G	Records of Landfill Gas Measurement by the Contractor
Appendix H	Summary of Exceedance
Appendix I	Site Audit Summary
Appendix J	Event Action Plans
Appendix K	Updated Environmental Mitigation Implementation Schedule
Appendix L	Waste Generation in the Reporting Month
Appendix M	Complaint Log
Appendix N	Construction Programme

**EXECUTIVE SUMMARY****Introduction**

1. This is the 4<sup>th</sup> monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for DSD Contract no. DC/2009/09 “Construction of Tai Po Sewage Treatment Works – Stage V Phase IIB”. This report documents the findings of EM&A Works conducted in October 2010.
2. The major site activities undertaken in the reporting month included:
  - Confined Space Works;
  - Dismantling works;
  - Drainage and Excavation works;
  - Landscaping works;
  - Mini-piling works;
  - Pre-drilling works;
  - Pre-bored socketted H-pilings; and
  - Pipeline works

**Environmental Monitoring and Audit Works**

3. Environmental monitoring and audit works for the Project were performed regularly as stipulated in the Final EM&A Manual and the results were checked and reviewed. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
4. Summary of the events and action taken in the reporting month is tabulated in **Table I**.

**Table I Summary Table for Events Recorded in the Reporting Month**

Parameter	No. of Exceedance		No. of Events Due to this Project	Action Taken
	Action Level	Limit Level		
1-hr TSP	0	0	0	N/A
24-hr TSP	0	0	0	N/A
Noise	0	0	0	N/A

5. In the reporting month, excavation works were undertaken within the 250m Consultation Zone of Shuen Wan Landfill. Landfill gas monitoring was performed by the Safety Officer of the Contractor. All the measured results were complied with the Limit Levels.

**Environmental Licenses and Permits**

6. Environmental related licenses/permits granted to the Project include the Environmental Permit (EP) for the Project, the Discharge Licence, Construction Noise Permit and the Waste Disposal (Chemical Waste) Licence.

**Key Information in the Reporting Month**

7. Summary of key information in this reporting month is tabulated in Table II.

**Table II Summary Table for Key Information in the Reporting Month**

Event	Event Details		Action Taken	Status	Remark
	Number	Nature			
Complaint received	0	---	N/A	N/A	---
Changes to the assumptions and key construction / operation activities recorded	0	---	N/A	N/A	---
Status of submissions under EP	1	Monthly EM&A Report (September 10)	Submitted to EPD on 15 <sup>th</sup> October 2010 (EP condition 6.6).	No comment	---
Notifications of any summons & prosecutions	0	---	N/A	N/A	---

**Future Key Issues**

8. Major site activities for the coming two months will include:

- Confined Space Works
- Structure works;
- Dismantling works;
- Drainage and Excavation works;
- Landscaping works;
- Mini-piling works;
- Pre-drilling works;
- Pre-bored socketted H-pilings; and
- Pipeline works

9. The future environmental concerns are air quality, noise impacts, waste management and surface runoff from construction works.

## 1 INTRODUCTION


### Background

- 1.1 Tai Po Sewage Treatment Works (TPSTW) is located within the Tai Po Industrial Estate. It currently comprises four Stages: I, II, IVA and IVB works. The TPSTW - Stage V aims to upgrade the existing STW to provide additional sewage treatment capacity from the present design flow of 88,000 m<sup>3</sup>/day to 130,000 m<sup>3</sup>/day to meet the demands of both the existing and future developments, and to meet the revised discharge license requirements.
- 1.2 The TPSTW Stage V, Phase I and Phase II are Designated Projects under the Environmental Impact Assessment Ordinance (Cap. 449) with the same EIAO Register No. AEIAR – 081/2004. A study of environmental impact assessment (EIA) was undertaken to evaluate various environmental impacts associated with the works within these two Designated Projects. An EIA Report as well as an Environmental Monitoring and Audit (EM&A) Manual were approved by the Environmental Protection Department (EPD) on 28 October 2004.
- 1.3 The Stage V works will be implemented in 2 phases. The design capacities of Phase I and Phase II works are 100,000 m<sup>3</sup>/d and 130,000 m<sup>3</sup>/d respectively. An Environmental Permit (EP) No. EP-265/2007 was issued on 22 March 2007 for the TPSTW Stage V Phase II to the Drainage Services Department (DSD) as the Permit Holder. The project “Tai Po Sewage Treatment Works – Stage V Phase IIB” formed part of the Phase II works, includes additional secondary treatment process units ( 1 primary clarifier; 3 bioreactors and 2 final clarifiers) in TPSTW for its future extended plant design capacity of 120,000 m<sup>3</sup>/day. A master construction programme of the Project is provided in **Appendix N**. A site layout plan is provided in **Figure 1.1**. The construction activities of the Project commenced on 3 July 2010.
- 1.4 Cinotech Consultants Ltd. was commissioned by the Contractor as the Environmental Team (ET) to undertake the EM&A works for the Project. Dr. Priscilla CHOY of Cinotech Consultants Ltd. was appointed as the ET Leader as per the Condition 2.1 of the EP. Ove Arup and Partners Hong Kong Limited. was appointed as the IEC under Condition 2.2 of the EP. This is the 4<sup>th</sup> monthly EM&A report summarizing the EM&A works for the Project in October 2010.

### Project Organizations

- 1.5 Different parties with different levels of involvement in the project organization include:
- Project Proponent / Engineer’s Representative (ER) – Drainage Services Department
  - Environmental Team (ET) – Cinotech Consultants Ltd.
  - Independent Environmental Checker (IEC) – Ove Arup and Partners Hong Kong Limited
  - Contractor – China Harbour Engineering Company Ltd.
- 1.6 The responsibilities of respective parties are detailed in Section 1.10 of the Final EM&A Manual of the Project.

## 1.7 The Project Organization during Construction Phase

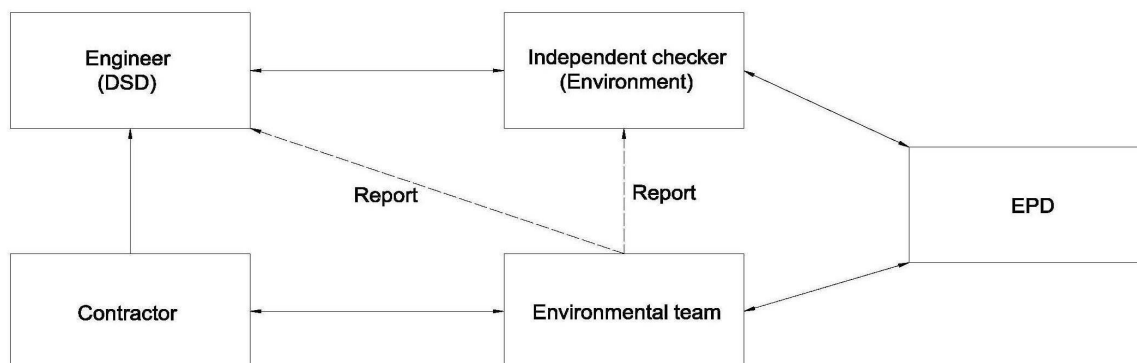1.8 The key contacts of the Project are shown in **Table 1.1**.**Table 1.1 Key Project Contacts**

Party	Role	Name	Position	Phone No.	Fax No.
DSD	SP Division	Mr. LAI cheuk-ho	Chief Engineer	2594 7500	2827 8700
		Mr. IP Shu-kuen	Senior Engineer	2594 7502	
		Mr. TSANG Lap-kei	Engineer	2594 7459	
Cinotech	Environmental Team	Dr. Priscilla CHOY	ET Leader	2151 2089	3107 1388
		Mr. TY YEUNG	Project Coordinator and Audit Team Leader	2151 2099	
		Mr. Henry LEUNG	Monitoring Team Leader	2151 2087	
Arup	Independent Environmental Checker	Mr. Coleman NG	Independent Environmental Checker	2268 3097	2528 3031
		Mr. Cyrus LEUNG	Assistant to Independent Environmental Checker	2268 3456	
CHEC	Civil Contractor	Mr. TK CHEUNG	Project Manager	9863 2954	2603 6899
		Mr. Aaron AU	Site Agent	6345 0754	
		Mr. Jason TSE	Environmental Officer	9320 3608	

**Construction Programme**

## 1.9 The site activities undertaken in the reporting month were:

- Confined Space Works;
- Dismantling works;
- Drainage and Excavation works;
- Landscaping works;
- Mini-piling works;
- Pre-drilling works;
- Pre-bored socketted H-pilings; and
- Pipeline works

**Summary of EM&A Requirements**

## 1.10 The EM&amp;A programme requires construction phase air quality and noise monitoring as well as environmental site audits. The EM&amp;A requirements are described in the

following sections, including:

- All monitoring parameters;
- Action and Limit levels for all environmental parameters;
- Event / Action Plans;
- Environmental mitigation measures, as recommended in the project EIA study final report; and
- Environmental requirements in contract documents.

1.11 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 5 of this report.

1.12 This report presents the monitoring results, observations, locations, equipment, period, methodology and QA/QC procedures of the required monitoring parameters, namely air quality and noise as well as audit works for the Project in the reporting month.



## 2 AIR QUALITY MONITORING

### Monitoring Requirements

- 2.1 Monitoring of 1-hour and 24-hour Total Suspended Particulates (TSP) was conducted to monitor the air quality during construction phase. **Appendix A** shows the established Action/Limit Levels for the environmental monitoring works.
- 2.2 In accordance with Section 2.30 of the EM&A Manual, a baseline checking of ambient TSP levels shall be carried out every six months at each monitoring station, when no dusty works activities are in operation. The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.

### Monitoring Locations

- 2.3 Impact air quality monitoring was conducted at the 3 monitoring stations, as shown in **Figure 1.2**. **Table 2.1** describes the locations of the air quality monitoring stations.

**Table 2.1 Locations for Air Quality Monitoring**

Monitoring Stations	Description	Location of Measurement
CAM1	Government Staff Quarters	Rooftop
CAM2	Hung Hing Printing Centre	On the site boundary just next to the Hung Hing Printing Centre
CAM3	Talcon Industrial Ltd.	On the site boundary just next to Talcon Industrial Ltd.

### Monitoring Equipment

- 2.4 **Table 2.2** summarizes the equipment used for the air quality monitoring.

**Table 2.2 Air Quality Monitoring Equipment**

Equipment	Model and Make	Qty.
HVS	Graseby GMW 2310 HVS, Model GS-2310105-1, Serial no. 10239 and 0810	2
	Tisch Environmental, Inc.; Model no. TE-5170, Serial no. 1704	1
Calibrator	Tisch Environmental, Inc.; Model no. TE-5028 <sup>a</sup> Serial no. 9833620	1

### Monitoring Parameters, Frequency and Duration

- 2.5 **Table 2.3** summarizes the monitoring parameters and frequencies of impact dust monitoring for the whole construction period.

**Table 2.3 Impact Dust Monitoring Parameters, Frequency and Duration**

Monitoring Stations	Parameter	Duration	Period	Frequency
CAM1, CAM2 and CAM3	1-hour TSP	1 hour	During daytime period	3 times / 6-day
	24-hour TSP	24 hours	24 hours	Once / 6-day

## Monitoring Methodology and QA/QC Procedure

### *Instrumentation*

- 2.6 High Volume Samplers (HVS) connected with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

### *HVS Installation*

- 2.7 The following guidelines were adopted during the installation of HVS:
- Sufficient support was provided to secure the samplers against gusty wind.
  - No two samplers were placed less than 2 meters apart.
  - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
  - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
  - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
  - No furnaces or incineration flues were nearby.
  - Airflow around the sampler was unrestricted.
  - The samplers were more than 20 meters from the drip line.
  - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.

### *Filters Preparation*

- 2.8 Fiberglass filters (G810) were used [Note: these filters have a collection efficiency of larger than 99% for particles of 0.3 mm diameter]. A HOKLAS accredited laboratory, Wellab Ltd., was responsible for the preparation of pre-weighed filter papers for Cinotech's monitoring team.
- 2.9 All filters, which were prepared by Wellab Ltd., were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than  $\pm 3$  °C; the relative humidity (RH) was < 50% and not variable by more than  $\pm 5\%$ . A convenient working RH was 40%.
- 2.10 Wellab Ltd. has a comprehensive quality assurance and quality control programmes.

### *Operating/Analytical Procedures*

2.11 Operating/analytical procedures for the TSP monitoring were highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 and 1.4 m<sup>3</sup>/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the air quality monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts to avoid air leakage at the edges.
- The shelter lid was closed and secured with the aluminum strip.
- The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- The flow rate of the HVS sampler would be verified to be constant and recorded on the data sheet after sampling.
- After sampling, the filter was removed and sent to the Wellab Ltd. for weighing. The elapsed time was also recorded.
- Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment should be between 25°C and 30°C and not vary by more than ±3°C; the relative humidity (RH) should be < 50% and not vary by more than ±5%. A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

### *Maintenance/Calibration*

2.12 The following maintenance/calibration was required for the HVS:

- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
- Calibration of the HVS (five point calibration) using Calibration Kit was carried out every two months. Copies of calibration certificates are attached in **Appendix B**.
- The HVS calibration orifice will be calibrated annually.

### **Results and Observations**

2.13 In the reporting month, 1-hr TSP monitoring was carried out as schedule at each designated monitoring station on 13 occasions. 24-hr TSP monitoring was carried out as scheduled at each designated monitoring station on 5 occasions. The monitoring schedule was updated and is shown in **Appendix C**. The weather during the monitoring sessions was mainly sunny and cloudy.

2.14 All measured 1-hr and 24-hr TSP levels were below the Action/Limit Levels. No exceedance was recorded in the reporting month.

2.15 The monitoring data and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices D** and **E**, respectively.

**Table 2.4 Summary Table of Air Quality Monitoring Results during the reporting month**

Parameter	Minimum $\mu\text{g}/\text{m}^3$	Maximum $\mu\text{g}/\text{m}^3$	Average $\mu\text{g}/\text{m}^3$	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
1-hr TSP (CAM1)	56	179	105	315	500
24-hr TSP (CAM1)	30	105	58	171	260
1-hr TSP (CAM2)	72	206	118	336	500
24-hr TSP (CAM2)	42	104	67	177	260
1-hr TSP (CAM3)	91	206	138	344	500
24-hr TSP (CAM3)	45	124	80	192	260

2.16 According to our field observations, the major dust source identified at the designated air quality monitoring stations are as follows:

Station	Major Pollution Source
CAM1 – Government Staff Quarters	Road Traffic Dust
CAM2 – Hung Hing Printing Centre	Road Traffic Dust and Excavation
CAM3 – Talcon Industrial Ltd.	Road Traffic Dust and Excavation

### 3 NOISE MONITORING

#### Monitoring Requirements

- 3.1 Noise monitoring was conducted in accordance with the EM&A Manual. **Appendix A** shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.

#### Monitoring Locations

- 3.3 Noise monitoring was conducted at one designated monitoring station as presented in **Table 3.1**. **Figure 1.2** shows the locations of the monitoring station.

**Table 3.1 Location of Noise Monitoring Station**

Monitoring Station	Description	Location of Measurement
NM1	Government Staff Quarters	The corridor at the first floor.

#### Monitoring Equipment

- 3.4 **Table 3.2** summarizes the noise monitoring equipment model being used.

**Table 3.2 Noise Monitoring Equipment**

Equipment	Model and Make	Quantity
Integrating Sound Level Meter	SVAN 955 (Serial No. 14303)	2
	SVAN 957 (Serial No. 21460)	
Calibrator	SV30A (Serial No.10929&10965)	2
Wind Speed Anemometer	Vane Anemometer, Model 451104 (Serial no. 9020746)	1

#### Monitoring Parameters, Frequency and Duration

- 3.5 **Table 3.3** summarizes the monitoring parameters, frequency and total duration of monitoring.

**Table 3.3 Noise Monitoring Parameters, Frequency and Duration**

Station	Parameter	Period	Frequency
NM1	$L_{eq}(30 \text{ min.})$ ( $L_{10}$ and $L_{90}$ were also recorded as supplementary information)	0700-1900 hrs. on normal weekdays	Once a week

- 3.6 If construction works are extended to include works during the hours of 1900 - 0700, additional weekly impact monitoring would be carried out during evening and night-time works. Applicable permits under NCO have been obtained by the Contractor. The details of the Construction Noise Permit can be referred to **Table 5.1**.

### 3.7 Monitoring Methodology and QA/QC Procedures

#### *Field Monitoring*

#### 3.8 The monitoring procedures are as follows:

- The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- The battery condition was checked to ensure good functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - frequency weighting : A
  - time weighting : Fast
  - measurement time : 30 minutes
- Prior to and after noise measurement, the meter was calibrated using the calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement is more than 1.0 dB, the measurement was considered invalid and repeat of noise measurement was required after re-calibration or repair of the equipment.
- The wind speed at the monitoring station was checked with the portable wind meter. Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.
- Noise measurement was paused during periods of high intrusive noise if possible and observation was recorded when intrusive noise was not avoided.
- At the end of the monitoring period, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.

#### *Maintenance and Calibration*

#### 3.9 Maintenance and Calibration procedures were as follows:

- The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- The sound level meter and calibrator were checked and calibrated at yearly intervals. Copies of calibration certificates are attached in **Appendix B**.

### Results and Observations

- 3.10 In the reporting month, noise monitoring during non-restricted hours was conducted as scheduled at the designated location on 4 occasions. As advised by the Contractor, no construction activities will be undertaken during restricted hours as such noise monitoring during restricted hours was omitted. The noise monitoring schedule is provided in **Appendix C**.
- 3.11 The details of the monitoring results and graphical presentations are shown in **Appendix F**. The weather during the monitoring sessions was mainly sunny and fine.
- 3.12 No Action/Limit Level exceedance for construction noise monitoring was recorded in the reporting month.

**Table 3.4 Summary Table of Noise Monitoring Results during the Reporting Month**

Parameter	Minimum Leq(30min) dB(A)	Maximum Leq(30min) dB(A)	Average Leq(30min) dB (A)	Action Level	Limit Level,
NM1	63.8	68.3	66.7	When one documented complaint is received	75dB(A)

- 3.13 According to our field observations, the major noise source identified at the designated air quality monitoring stations are as follows:

Station	Major Noise Source
NM1 – Government Staff Quarters	Road Traffic Construction of Main Site

## 4 LANDFILL GAS MONITORING

### Monitoring Requirements

- 4.1 In accordance with Section 6 of the EM&A Manual, monitoring of landfill gas is required for construction works within the 250m Consultation Zone of Shuen Wan Landfill (the Consultation Zone). This Section reports the results of landfill gas measurements performed by the Safety Officer of the Contractor. **Appendix A** shows the Limit Levels for the monitoring works.

### Monitoring Parameters and Frequency

- 4.2 The parameters for Landfill gas monitoring include Percentage of Combustible Gas (Methane), Carbon dioxide and Oxygen.
- 4.3 The Landfill gas monitoring is carried out before the entry of concern zone by the Contractor in the morning and afternoon.

### Monitoring Locations

- 4.4 Monitoring of oxygen, methane and carbon dioxide was performed for excavations at 1m depth or more within the Consultation Zone. In this reporting month, the area required to be monitored for landfill gas are shown below and **Figure 1.3** shows the landfill gas monitoring locations.
- FC11B and FC12B

#### Remark:

Excavation works of 1m depth or more at Pipe 300, 600 and 900 Excavation Trench has been completed.

### Monitoring Equipment

- 4.5 **Table 4.1** summarizes the equipment employed by the Contractor for the landfill gas monitoring.

**Table 4.1 Landfill Gas Monitoring Equipment**

Equipment	Model and Make	Quantity
Intrinsically safe, portable gas detector	Crowcon Custodian CDL Portable Gas Detector (Serial No. 24800 37076)	1

### Results

- 4.6 In the reporting month, landfill gas monitoring was carried out by the Contractor at the aforesaid locations on total 188 occasions. No Action/Limit Level exceedance for Landfill gas monitoring was recorded in the reporting month. The monitoring results are provided in **Appendix G**. Copies of calibration certificates are attached in **Appendix B**.



## 5 ENVIRONMENTAL AUDIT

### Site Audits

- 5.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Project site. The summaries of site audits are attached in **Appendix H**.
- 5.2 Site audits were conducted on 8<sup>th</sup>, 14<sup>th</sup>, 21<sup>st</sup> and 28<sup>th</sup> October 2010 by ET. A joint site audit with the representative with IEC, ER, the Contractor and the ET was carried out on 8<sup>th</sup> October 2010. No site inspection was conducted by EPD during the reporting month. The details of observations during site audit can refer to **Table 5.2**.

### Review of Environmental Monitoring Procedures

- 5.3 The monitoring works conducted by the monitoring team were inspected regularly. The following observations have been recorded for the monitoring works:

#### *Air Quality Monitoring*

- The monitoring team recorded all observations around the monitoring stations within and outside the construction site.
- The monitoring team recorded the temperature and weather conditions on the monitoring days.

#### *Noise Monitoring*

- The monitoring team recorded all observations around the monitoring stations, which might affect the monitoring result.
- Major noise sources were identified and recorded. Other intrusive noise attributing to the result was trimmed off by pausing the monitoring temporarily.

#### *Landfill Gas Monitoring*

- The Contractor has checked the condition of the equipment before monitoring to ensure the reliability.

### Status of Environmental Licensing and Permitting

- 5.4 All permits/licenses obtained for the Project are summarized in **Table 5.1**.

**Table 5.1 Summary of Environmental Licensing and Permit Status**

Permit / License No.	Valid Period		Details	Status
	From	To		
<b>Environmental Permit (EP)</b>				
EP-265/2007	22/3/2007	N/A	<u>Expansion and upgrading of existing Tai Po Sewage Treatment Works from 100,000 m<sup>3</sup>/day to 130,000 m<sup>3</sup>/day:</u> (a) additional secondary treatment process units(1 primary clarified; 3 bioreactors and 2 final clarifiers); (b) reconstruction of 4 existing final clarified; (c) provision of ultraviolet disinfection facilities; (d) additional sludge treatment facilities; and (e) ancillary works to existing treatment facilities.	Valid
<b>Construction Noise Permit (CNP)</b>				
GW-RN0137-10	17/05/10	16/11/10	Use of powered mechanical equipment for carrying out construction work at 7 Dai Kwai Street, Tai Po Industrial Estate, Tai Po, N.T. during 0000 – 2400 hours on general holidays (including Sundays), 0000 – 0700 hours and 1900 – 2400 hours on any day not being a general holiday.	Vaild
<b>Discharge Licence</b>				
WT00007782-2010	25/10/10	31/10/15	Discharge of industrial trade effluent: <i>Water Control Zone:</i> Tolo Harbour and Channel <i>Discharge Points:</i> Communal drain for the carriage of surface drainage water	Valid
<b>Waste Disposal (Chemical Waste)</b>				
WPN : 5213-727-C2397-16	09/07/10	End of Project	Disposal of Chemical Waste including spent oil, lubricating oil, diesel oil and methanol, surplus paint, thinner	Valid

**Status of Waste Management**

5.5 The Construction and Demolition (C&D) materials generated in the reporting month were mainly inert C&D waste and C&D waste. The quantities of waste generated in this reporting month are summarized in **Appendix L**. No chemical waste was generated in the reporting month.

### Implementation Status of Environmental Mitigation Measures

- 5.6 According to the EIA Study Report, Environmental Permit and the EM&A Manual of the Project, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix K**.
- 5.7 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 5.2**.

**Table 5.2 Observations and Recommendations of Site Audit**

Parameters	Date	Observations and Recommendations	Follow-up
<i>Reminder</i>	8-October-2010	The Contractor was reminded to reinforce with bund near the u-channel at near tank 7.	The situation was observed rectified in audit session 101014.
	8-October-2010	The Contractor was reminded to cover with impervious material at stockpile at Sludge Sediment Tank and Biogas Holding Tank.	The situation was observed rectified in audit session 101014.
	8-October-2010	Deposited mud should be cleared at soaking pit at A-Tank 5 and 6.	The situation was observed rectified in audit session 101014.
	14-October-2010	Stagnant water was observed within the drip tray. The Contractor was reminded to clear it.	The situation was observed rectified in audit session 101021.
	21-October-2010	General refuse should be stored within the recycling bin at tank 11 and 12.	The situation required follow-up action during the coming audit session.
	28-October-2010	The Contractor was reminded to water the site regularly.	The situation required follow-up action during the coming audit session.
	28-October-2010	The general refuse should be cleared at A-Tank.	The situation required follow-up action during the coming audit session.

### Summary of Exceedances

- 5.8 No exceedance of monitoring results was recorded in the reporting month. Summary of exceedance is provided in **Appendix H**.

### Implementation Status of Event Action Plans

- 5.9 The Event Action Plans for air quality, construction noise and landfill gas monitoring are presented in **Appendix J**. No exceedance was recorded and thus no action was

required to be implemented.

### **Summary of Complaint and Prosecution**

- 5.10 No environmental related complaint, prosecution or notification of summons was received in the reporting month.
- 5.11 There was no environmental complaint, prosecution or notification of summons received since the Project commencement. The Complaint Log is attached in **Appendix M**.

## **6 FUTURE KEY ISSUES**

- 6.1 Key issues to be considered in the coming month include:
- Effluent discharge generated from surface runoff;
  - Dust generated from excavation works, backfilling works and stockpile of dusty materials;
  - Maintenance of de-silting facilities and drainage system, such as U-channels;
  - Accumulation of stagnant water in the site areas; and
  - Accumulation of C&D waste and general waste on site.

### **Monitoring Schedule for the Next Month**

- 6.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix C**.

### **Construction Program for the Next Month**

- 6.3 A tentative construction programme is provided in **Appendix N**. The major construction activities in the coming month will include:
- Confined Space Works
  - Structure works;
  - Dismantling works;
  - Drainage and Excavation works;
  - Landscaping works;
  - Mini-piling works;
  - Pre-drilling works;
  - Pre-bored socketted H-pilings; and
  - Pipeline works

## 7 CONCLUSIONS AND RECOMMENDATIONS

### Conclusions

- 7.1 Environmental monitoring and audit works were conducted in the reporting month. Site inspections were conducted on a weekly basis. The results were reviewed and checked.
- 7.2 No exceedance of monitoring results was recorded in the reporting month.
- 7.3 There was no environmental complaint, prosecution or notification of summons received.

### Recommendations

- 7.4 According to the environmental audit performed in the reporting month, the following recommendations were made:

#### *Water Impact*

- To provide sediment tank for settling runoff prior to disposal.
- To ensure proper use and maintenance of the de-silting facilities.
- To avoid accumulation of stagnant water on site.
- To maintain sand bags placed along the u-channel at good condition and replace the broken bags.
- To avoid blockage of gully inlets and ensure proper protection of the gully from ingress of sandy water.

#### *Dust Impact*

- To remove fugitive dusty material on the haul road periodically.
- To spray with water on the surface of concrete breaking and dry dust haul road.
- Excavated dusty materials or stockpile of dusty materials should be covered by impervious sheeting, or sprayed with water so as to maintain entire surface wet.

#### *Noise Impact*

- To space out noisy equipment and position as far away as possible from sensitive receivers.

#### *Waste / Chemical Management*

- To provide proper rubbish bins / skips for waste collection.
- To provide proper storage area for oil container on site.
- To avoid and check for any accumulation of waste materials or rubbish on site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the equipment.
- Provide drip tray with adequate capacity and maintain well for equipment and chemical waste.


---

---

## FIGURES

---

---

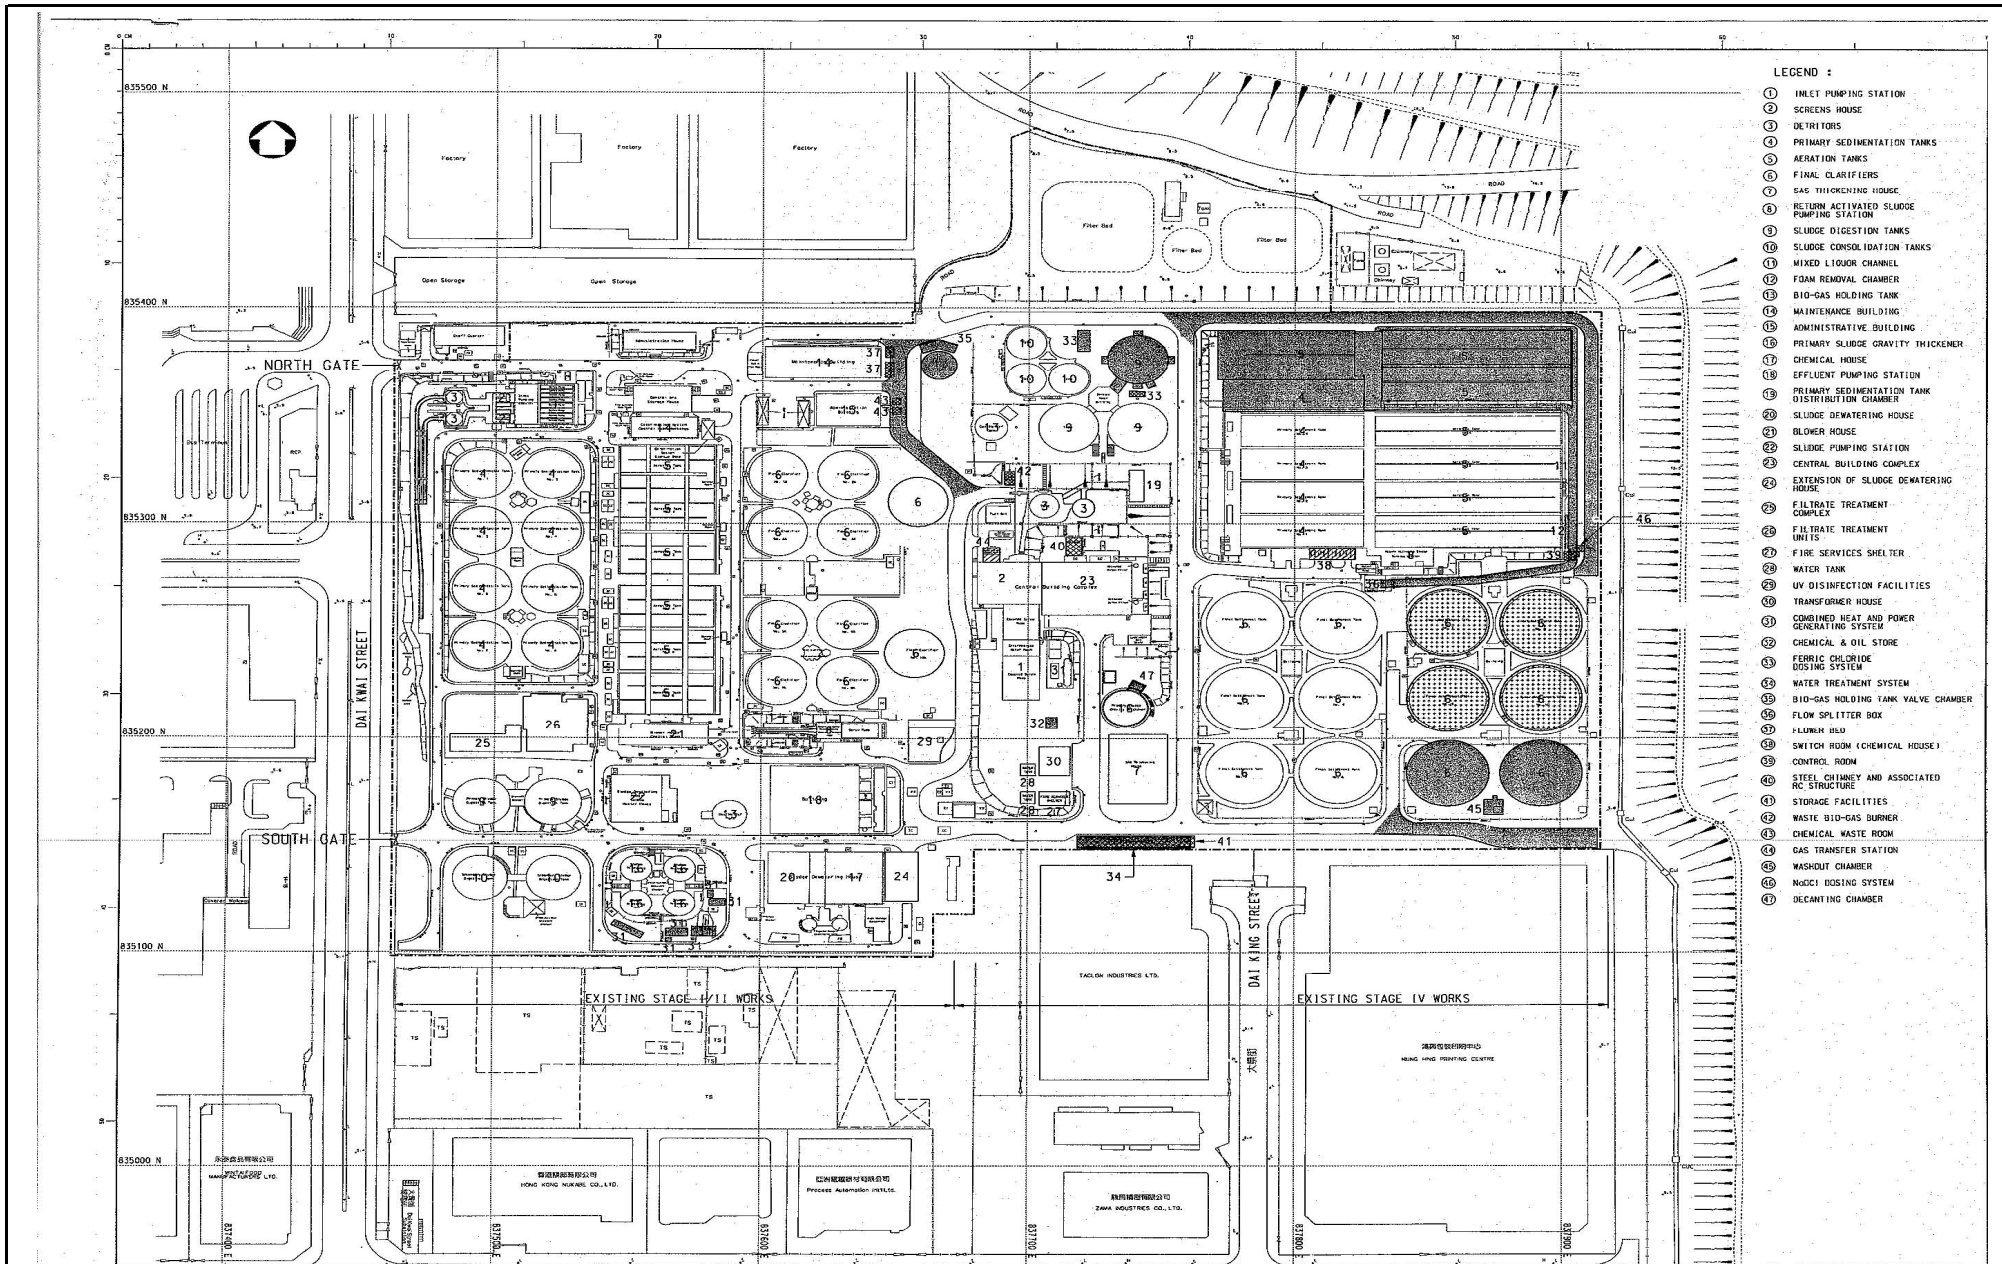


- LEGEND :
- ① INLET PUMPING STATION
  - ② SCREENS HOUSE
  - ③ DETRIERS
  - ④ PRIMARY SEDIMENTATION TANKS
  - ⑤ AERATION TANKS
  - ⑥ FINAL CLARIFIERS
  - ⑦ GAS THICKENING HOUSE
  - ⑧ REDUCTION ACTIVATED SLUDGE PUMPING STATION
  - ⑨ SLUDGE DIGESTION TANKS
  - ⑩ SLUDGE CONSOLIDATION TANKS
  - ⑪ MIXED LIQUOR CHANNEL
  - ⑫ FOG REMOVAL CHAMBER
  - ⑬ BIO-GAS HOLDING TANK
  - ⑭ MAINTENANCE BUILDING
  - ⑮ ADMINISTRATIVE BUILDING
  - ⑯ PRIMARY SLUDGE GRAVITY THICKENER
  - ⑰ CHEMICAL HOUSE
  - ⑱ EFFLUENT PUMPING STATION
  - ⑲ PRIMARY SEDIMENTATION TANK DISTRIBUTION CHAMBER
  - ⑳ SLUDGE DEWATERING HOUSE
  - ㉑ BLOWER HOUSE
  - ㉒ SLUDGE PUMPING STATION
  - ㉓ CENTRAL BUILDING COMPLEX
  - ㉔ EXTENSION OF SLUDGE DEWATERING HOUSE
  - ㉕ FILTRATE TREATMENT COMPLEX
  - ㉖ FILTRATE TREATMENT UNITS
  - ㉗ FIRE SERVICES SHELTER
  - ㉘ WATER TANK
  - ㉙ UV DISINFECTION FACILITIES
  - ㉚ TRANSFORMER HOUSE
  - ㉛ COMBINED HEAT AND POWER GENERATING SYSTEM
  - ㉜ CHEMICAL & OIL STORE
  - ㉝ FERRIC CHLORIDE DOSING SYSTEM
  - ㉞ WATER TREATMENT SYSTEM
  - ㉟ BIO-GAS HOLDING TANK VALVE CHAMBER
  - ㊱ FLOW SPLITTER BOX
  - ㊲ FLUMM BELL
  - ㊳ SWITCH ROOM (CHEMICAL HOUSE)
  - ㊴ CONTROL ROOM
  - ㊵ STEEL CHIMNEY AND ASSOCIATED RC STRUCTURE
  - ㊶ STORAGE FACILITIES
  - ㊷ WASTE BIO-GAS BURNER
  - ㊸ CHEMICAL WASTE ROOM
  - ㊹ GAS TRANSFER STATION
  - ㊺ WASHOUT CHAMBER
  - ㊻ NODDI DOSING SYSTEM
  - ㊼ DEWATERING CHAMBER

TAI PO SEWAGE TREATMENT WORKS, STAGE V, PHASE IIB

PROJECT SITE LAYOUT PLAN (TPSTW)

Scale	N.T.S	Project No.	MA0010	<b>CINOTECH</b>
Date	Jul-10	Figure	1.1	

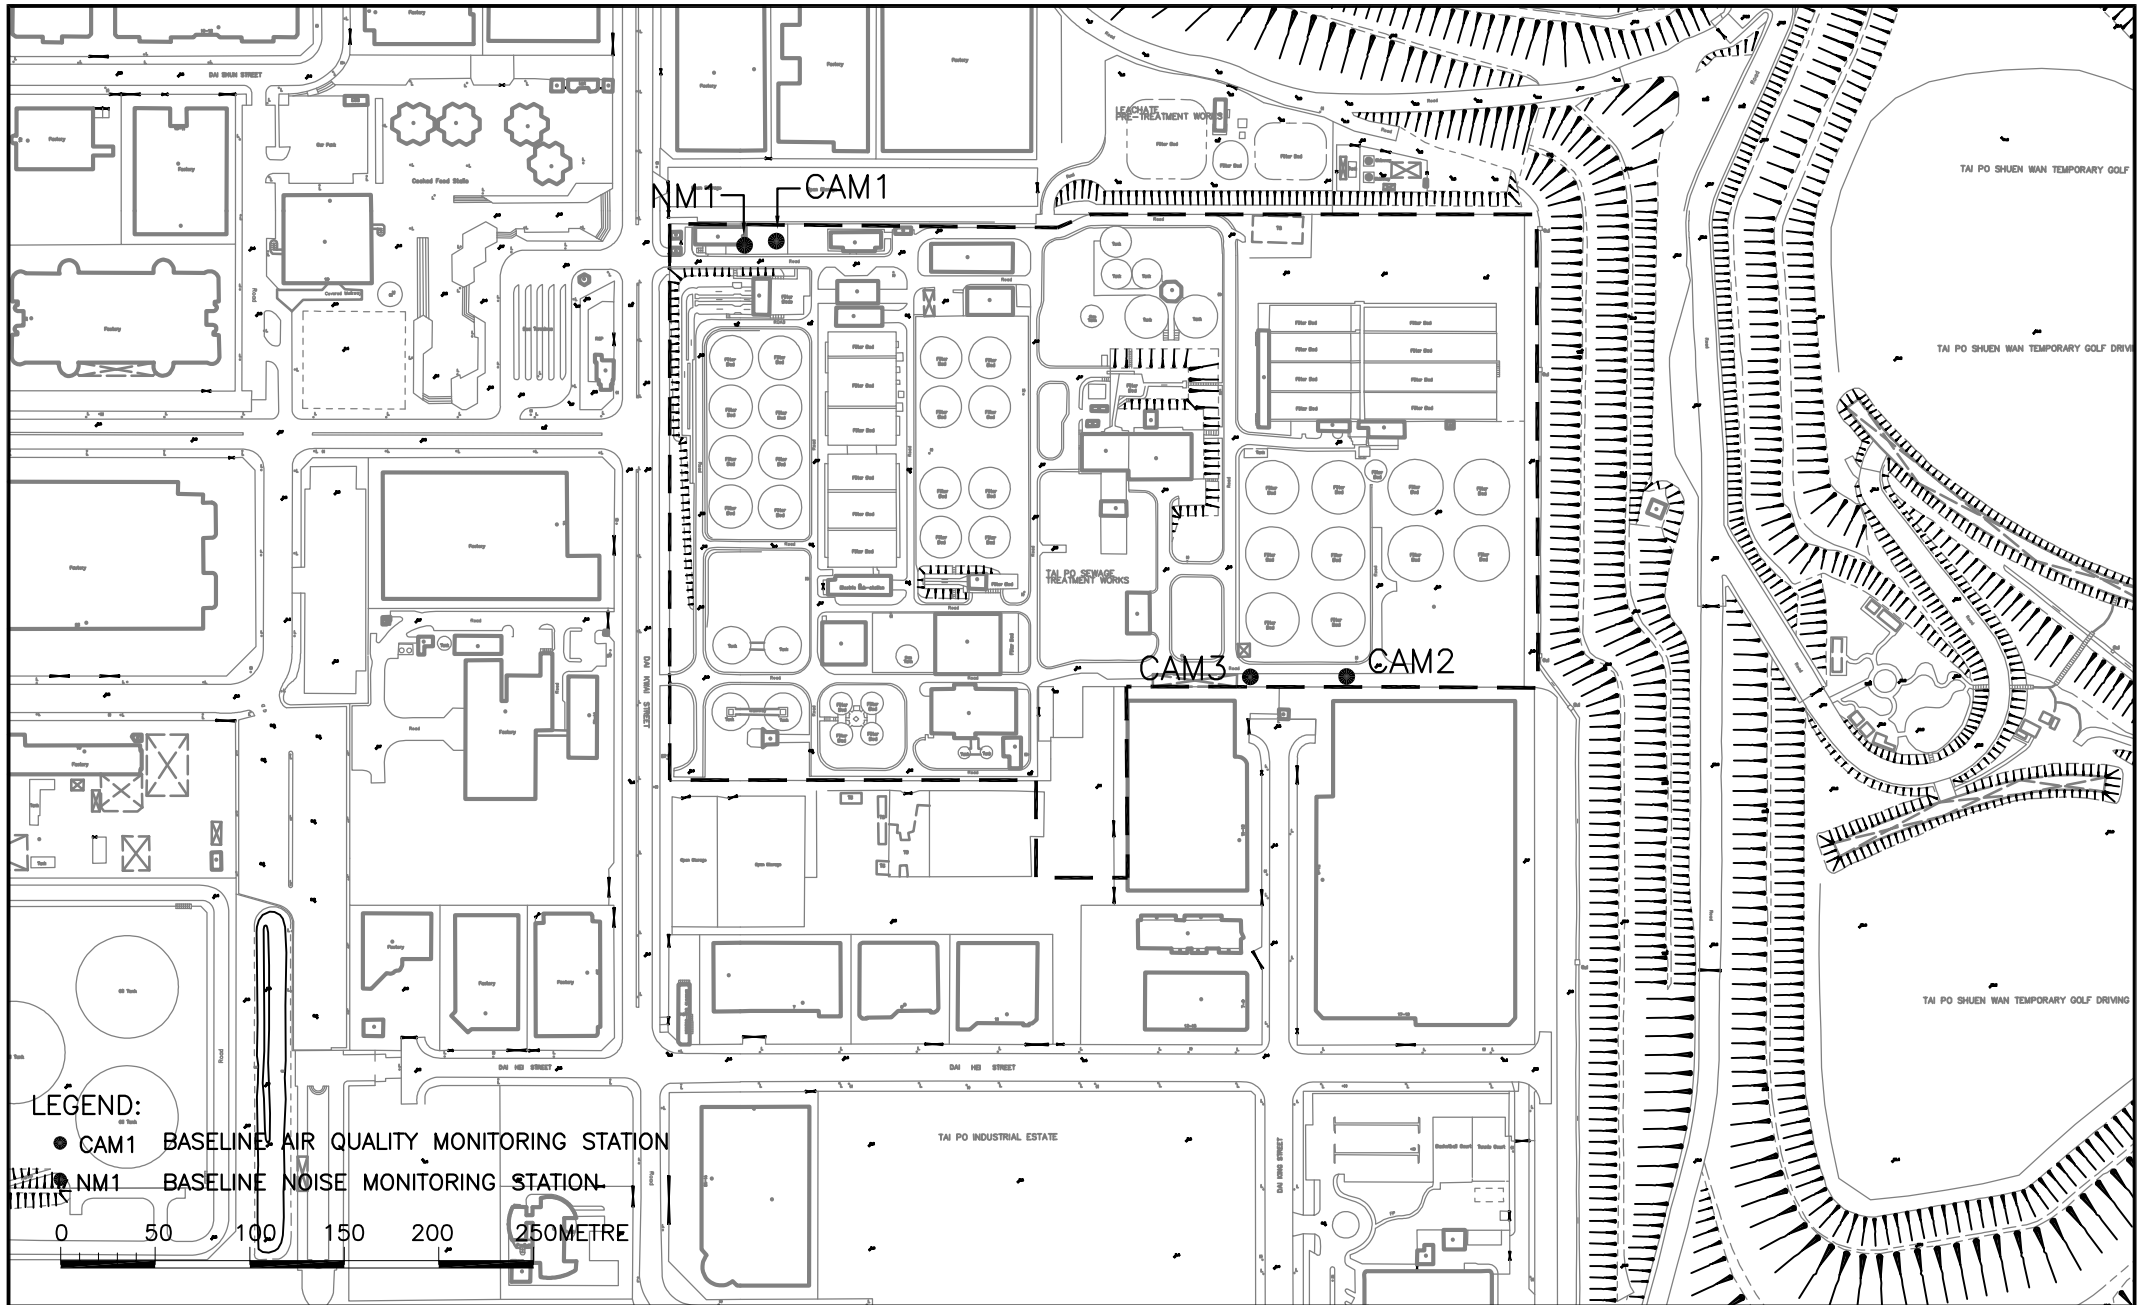

**LEGEND:**

- CAM1 BASELINE AIR QUALITY MONITORING STATION
- NM1 BASELINE NOISE MONITORING STATION

0 50 100 150 200 250METRE




Tai Po Sewage Treatment Work, Stage V, Phase IIB

**LOCATIONS OF AIR QUALITY AND NOISE MONITORING STATIONS**

SCALE	A4 1:4000	DATE	2010	
CHECK	IT	DRAWN	SL	
JOB No.	MA0010	DRAWING No.	1.2	REV —



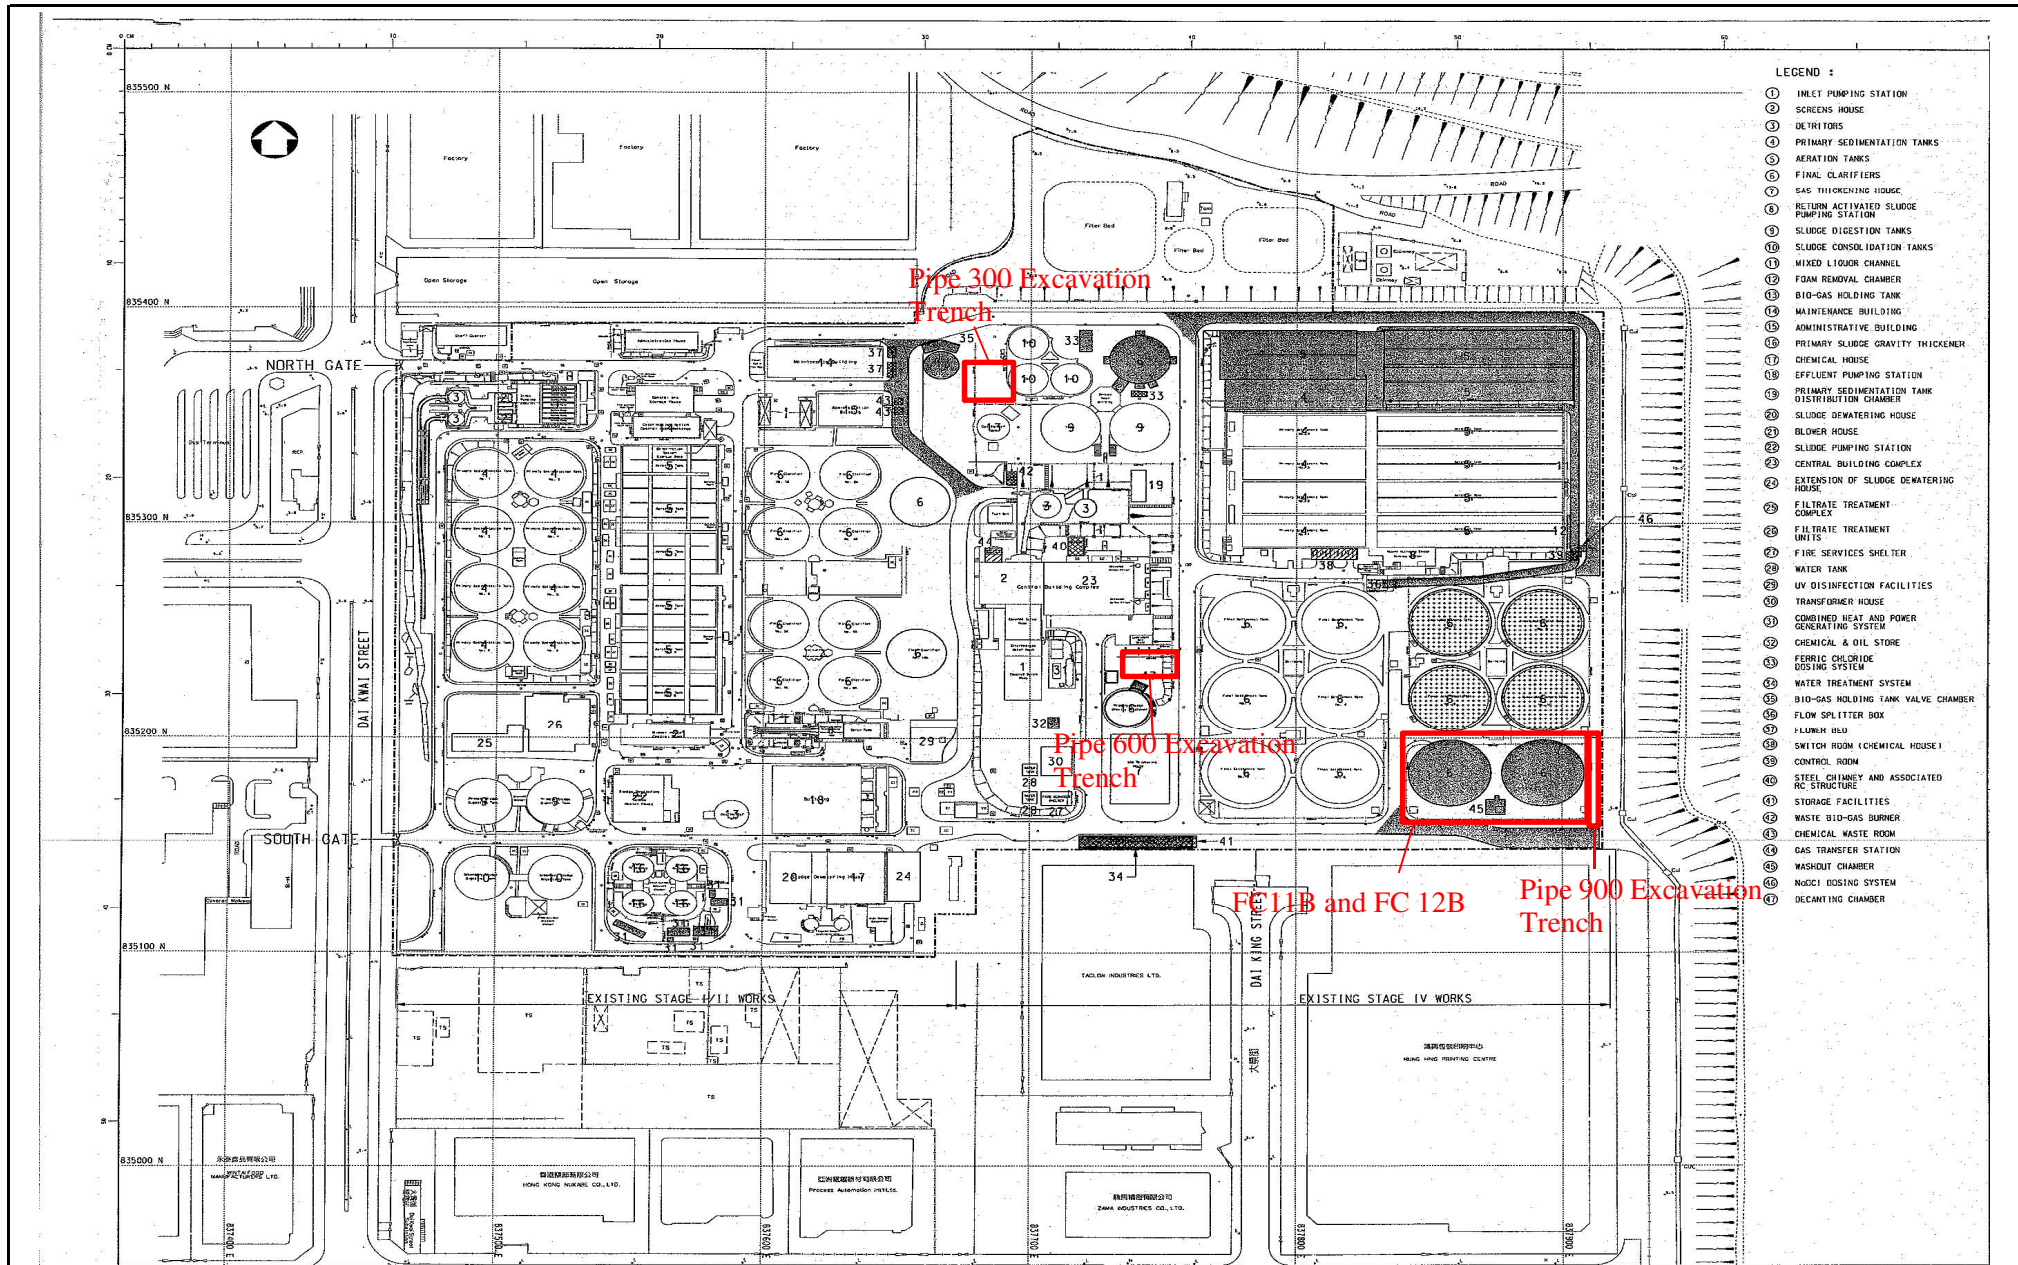

- LEGEND :
- ① INLET PUMPING STATION
  - ② SCREENS HOUSE
  - ③ DETRIORS
  - ④ PRIMARY SEDIMENTATION TANKS
  - ⑤ AERATION TANKS
  - ⑥ FINAL CLARIFIERS
  - ⑦ GAS THICKENING HOUSE
  - ⑧ REDUCTION ACTIVATED SLUDGE PUMPING STATION
  - ⑨ SLUDGE DIGESTION TANKS
  - ⑩ SLUDGE CONSOLIDATION TANKS
  - ⑪ MIXED LIQUOR CHANNEL
  - ⑫ FOG REMOVAL CHAMBER
  - ⑬ BIO-GAS HOLDING TANK
  - ⑭ MAINTENANCE BUILDING
  - ⑮ ADMINISTRATIVE BUILDING
  - ⑯ PRIMARY SLUDGE GRAVITY THICKENER
  - ⑰ CHEMICAL HOUSE
  - ⑱ EFFLUENT PUMPING STATION
  - ⑲ PRIMARY SEDIMENTATION TANK DISTRIBUTION CHAMBER
  - ⑳ SLUDGE DEWATERING HOUSE
  - ㉑ BLOWER HOUSE
  - ㉒ SLUDGE PUMPING STATION
  - ㉓ CENTRAL BUILDING COMPLEX
  - ㉔ EXTENSION OF SLUDGE DEWATERING HOUSE
  - ㉕ FILTRATE TREATMENT COMPLEX
  - ㉖ FILTRATE TREATMENT UNITS
  - ㉗ FIRE SERVICES SHELTER
  - ㉘ WATER TANK
  - ㉙ UV DISINFECTION FACILITIES
  - ㉚ TRANSFORMER HOUSE
  - ㉛ COMBINED HEAT AND POWER GENERATING SYSTEM
  - ㉜ CHEMICAL & OIL STORE
  - ㉝ FERRIC CHLORIDE DOSING SYSTEM
  - ㉞ WATER TREATMENT SYSTEM
  - ㉟ BIO-GAS HOLDING TANK VALVE CHAMBER
  - ⓫ FLOW SPLITTER BOX
  - ⓬ FLURK HOLD
  - ⓭ SWITCH ROOM (CHEMICAL HOUSE)
  - ⓮ CONTROL ROOM
  - ⓯ STEEL CHIMNEY AND ASSOCIATED RC STRUCTURE
  - ⓰ STORAGE FACILITIES
  - ⓱ WASTE BIO-GAS BURNER
  - ⓲ CHEMICAL WASTE ROOM
  - ⓳ GAS TRANSFER STATION
  - ⓴ WASHOUT CHAMBER
  - ⓵ NODDI DOSING SYSTEM
  - ⓶ DECAINTING CHAMBER

TAI PO SEWAGE TREATMENT WORKS, STAGE V, PHASE IIB

Landfill Gas Monitoring Area(TPSTW)

Scale	N.T.S	Project No.	MA0010
Date	Jul-10	Figure	1.3



---

---

**APPENDIX A  
ACTION AND LIMIT LEVELS**

---

---

**APPENDIX A – Action and Limit Levels****1-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
CAM1	315	500
CAM2	336	
CAM3	344	

**24-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
CAM1	171	260
CAM2	177	
CAM3	192	

**Construction Noise**

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)
0700-2300 hrs on holidays; and 1900-2300 hrs on all other days		70* dB(A)
2300-0700 hrs of next day		55* dB(A)

Notes:

\* The Area Sensitivity Rating for Station NM1 is taken as C, due to the nearby industrial area, according to Table 1 of EPD's Technical Memorandum on Noise from Construction Work other than Percussive Piling.

**Landfill Gas**

Parameter	Limit Level	Action
Oxygen	<19%	Ventilate to restore oxygen to >19%
	<18%	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore oxygen to >19%
Methane	>10% LEL (i.e. >0.5% by volume)	Post “No Smoking” signs Prohibit hot works Ventilate to restore methane to <10% LEL
	>20% LEL (i.e. >1% by volume)	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore methane to <10%
Carbon Dioxide	>0.5%	Ventilate to restore carbon dioxide to <0.5%
	>1.5%	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore carbon dioxide to <0.5%

---

---

**APPENDIX B  
COPIES OF CALIBRATION  
CERTIFICATES**

---

---

## High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA0010/37/0034

Station: CAM1 - Government Staff Quarter  
 Date: 30-Sep-10  
 Equipment No.: A-01-37

Operator: CH  
 Next Due Date: 29-Nov-10  
 Serial No.: 1704

Ambient Condition			
Temperature, Ta (K)	301.3	Pressure, Pa (mmHg)	761.7

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0448	Intercept, bc	0.0086
Last Calibration Date:	4-Nov-09	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Nov-10	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] <sup>1/2</sup>	Qstd (CFM) X - axis	ΔW (HVS), in. of oil	[ΔW x (Pa/760) x (298/Ta)] <sup>1/2</sup> Y-axis
1	11.8	3.42	76.15	7.8	2.78
2	9.8	3.12	69.38	6.4	2.52
3	7.6	2.74	61.07	5.1	2.25
4	5.0	2.23	49.50	3.3	1.81
5	3.3	1.81	40.18	2.0	1.41

By Linear Regression of Y on X

Slope, mw = 0.0377                                  Intercept, bw : -0.0808

Correlation coefficient\* = 0.9991

\*If Correlation Coefficient < 0.990, check and recalibrate.

### Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM

From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W =  $(mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$  2.39

Remarks: \_\_\_\_\_  
 \_\_\_\_\_

Conducted by:   *an*            Signature:           *an*                    Date:           30/9/10            
 Checked by:           *Wah Tang*                    Signature:           *Kwai*                    Date:           30 September 2010

# High-Volume TSP Sampler

## 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA0010/A40/0034

Station CAM2 - Hung Hing Printing Centre Operator: CH  
 Date: 30-Sep-10 Next Due Date: 29-Nov-10  
 Equipment No.: A-01-40 Serial No. 10239

Ambient Condition			
Temperature, Ta (K)	301.3	Pressure, Pa (mmHg)	761.7

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0448	Intercept, bc	0.0086
Last Calibration Date:	4-Nov-09	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Nov-10	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] <sup>1/2</sup>	Qstd (CFM) X - axis	ΔW (HVS), in. of oil	[ΔW x (Pa/760) x (298/Ta)] <sup>1/2</sup> Y-axis
1	11.8	3.42	76.15	7.9	2.80
2	9.7	3.10	69.02	6.5	2.54
3	7.5	2.73	60.67	5.0	2.23
4	5.1	2.25	50.00	3.3	1.81
5	3.2	1.78	39.56	1.9	1.37

By Linear Regression of Y on X

Slope, mw = 0.0389 Intercept, bw : -0.1510  
 Correlation coefficient\* = 0.9996

\*If Correlation Coefficient < 0.990, check and recalibrate.

### Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM  
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W =  $(mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$  2.34

Remarks: \_\_\_\_\_

Conducted by: [Signature] Signature: [Signature]  
 Checked by: [Signature] Signature: [Signature]

Date: 30/9/10  
 Date: 30 September 2010

# High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

**CINOTECH**

File No. MA0010/35/0034

Station CAM3 - Talcon Industrial Ltd  
Date: 30-Sep-10  
Equipment No.: A-01-35

Operator: CH  
Next Due Date: 29-Nov-10  
Serial No. 0810

Ambient Condition			
Temperature, Ta (K)	301.3	Pressure, Pa (mmHg)	761.7

Orifice Transfer Standard Information					
Equipment No.:	A-04-06	Slope, mc	0.0448	Intercept, bc	0.0086
Last Calibration Date:	4-Nov-09	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	3-Nov-10	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] <sup>1/2</sup>	Qstd (CFM) X - axis	ΔW (HVS), in. of oil	[ΔW x (Pa/760) x (298/Ta)] <sup>1/2</sup> Y-axis
1	11.8	3.42	76.15	7.8	2.78
2	9.7	3.10	69.02	6.5	2.54
3	7.5	2.73	60.67	5.1	2.25
4	5.0	2.23	49.50	3.3	1.81
5	3.1	1.75	38.94	2.0	1.41

By Linear Regression of Y on X  
Slope, mw = 0.0371      Intercept, bw : -0.0259  
Correlation coefficient\* = 0.9996

\*If Correlation Coefficient < 0.990, check and recalibrate.

**Set Point Calculation**

From the TSP Field Calibration Curve, take Qstd = 43 CFM  
From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point;  $W = (mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$  2.48

Remarks: \_\_\_\_\_  
\_\_\_\_\_

Conducted by: <u>Lu</u>	Signature: <u>Lu</u>	Date: <u>30/9/10</u>	
Checked by: <u>Wk Tang</u>	Signature: <u>Wk Tang</u>	Date: <u>30 September 2010</u>	



## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

Test Report No.:	C/A/100504
Date of Issue:	2010-05-04
Date Received:	2010-04-30
Date Tested:	2010-04-30
Date Completed:	2010-04-30
Next Due Date:	2011-05-03

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

Description : RS232 Integral Vane Digital Anemometer  
Manufacturer : AZ Instrument  
Model No. : 451104  
Serial No. : 9020746  
Equipment No. : A-03-01

**Test conditions:**

Room Temperature : 22 degree Celsius  
Relative Humidity : 68%  
Pressure : 101.3 kPa

**Methodology:**

The anemometer has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

**Results:**

	Reference Set Point	Instrument Readings
Measuring Air Velocity, m/s	2.00	2.00
Temperature, °C	21.0	21.0

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**



**PATRICK TSE**  
*Laboratory Manager*



TISCH ENVIRONMENTAL, INC  
 145 SOUTH MIAMI AVE.  
 VILLAGE OF CLEVELAND, OH 45002  
 513.467.9000  
 877.263.7610 TOLL FREE  
 513.467.9009 FAX  
 WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5028A

Date - Nov 04, 2009 Rootsmeter S/N 9833620 Ta (K) - 295  
 Operator Tisch Orifice I.D. - 1272 Pa (mm) - 758.19

PLATE OR VDC #	VOLUME START (m3)	VOLUME STOP (m3)	DIFF VOLUME (m3)	DIFF TIME (min)	METER DIFF Hg (mm)	ORFICE DIFF H2O (in.)
1	NA	NA	1.00	1.2800	4.2	1.50
2	NA	NA	1.00	0.9910	7.1	2.50
3	NA	NA	1.00	0.9050	8.5	3.00
4	NA	NA	1.00	0.8350	9.9	3.50
5	NA	NA	1.00	0.6320	17.1	6.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)	Va	(x axis) Qa	(y axis)
1.0021	0.7829	1.2295	0.9944	0.7769	0.7640
0.9983	1.0073	1.5873	0.9906	0.9996	0.9863
0.9964	1.1010	1.7388	0.9887	1.0925	1.0804
0.9946	1.1911	1.8781	0.9869	1.1819	1.1670
0.9850	1.5586	2.4590	0.9774	1.5466	1.5279
Qstd slope (m) = 1.58420			Qa slope (m) = 0.99200		
intercept (b) = -0.00884			intercept (b) = -0.00549		
coefficient (r) = 0.99998			coefficient (r) = 0.99998		
y axis = SQRT[H2O (Pa/760) (298/Ta)]			y axis = SQRT[H2O (Ta/Pa)]		

CALCULATIONS

Vstd = Diff. Vol [(Pa-Diff. Hg)/760] (298/Ta)  
 Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]  
 Qa = Va/Time


For subsequent flow rate calculations:

Qstd = 1/m { [SQRT (H2O (Pa/760) (298/Ta))] - b }  
 Qa = 1/m { [SQRT H2O (Ta/Pa)] - b }



TISCH ENVIROMENTAL, INC.  
 145 SOUTH MIAMI AVE.  
 VILLAGE OF CLEVES, OH 45002  
 513.467.9000  
 877.263.7610 TOLL FREE  
 513.467.9009 FAX  
 WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

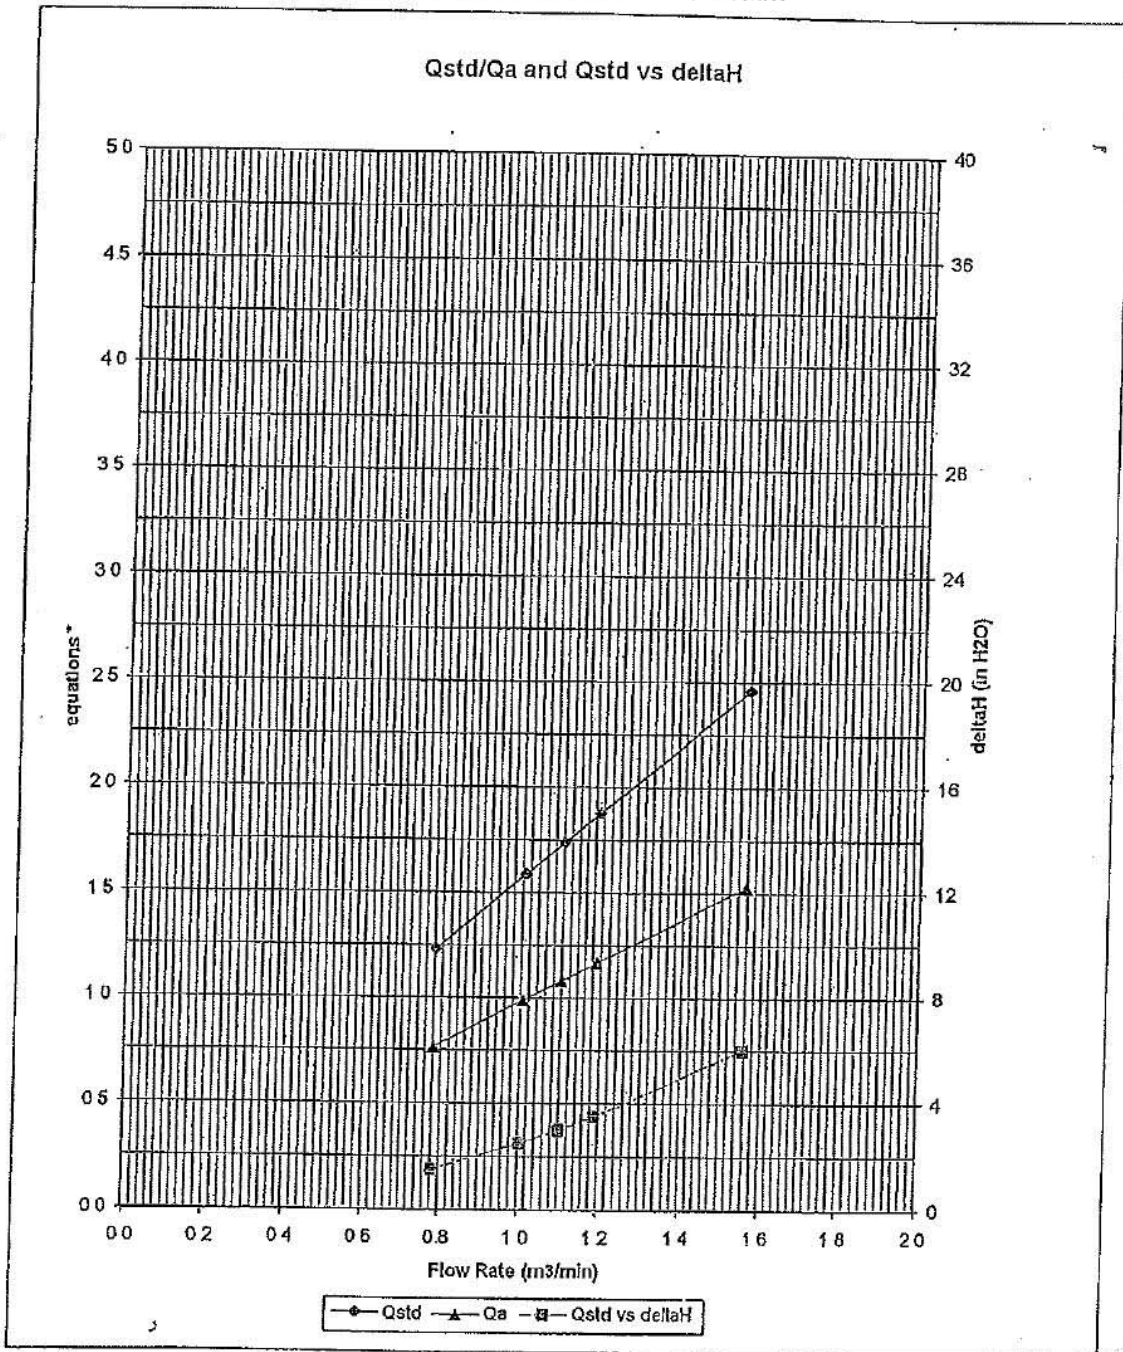

\* y-axis equations:

Qstd series: 
$$\sqrt{\Delta H \left( \frac{P_a}{P_{std}} \right) \left( \frac{T_{std}}{T_a} \right)}$$

Qa series: 
$$\sqrt{(\Delta H (T_a / P_a))}$$

## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

Test Report No.:	C/N/100123/1
Date of Issue:	2010-01-23
Date Received:	2010-01-22
Date Tested:	2010-01-23
Date Completed:	2010-01-23
Next Due Date:	2011-01-22

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

Description	: 'SVANTEK' Integrating Sound Level Meter
Manufacturer	: SVANTEK
Model No.	: SVAN 955
Serial No.	: 14303
Microphone No.	: 17204
Equipment No.	: N-08-05

**Test conditions:**

Room Temperature	: 21 degree Celsius
Relative Humidity	: 56%

**Test Specifications:**

Performance checking at 94 and 114 dB

**Methodology:**

In-house method, according to manufacturer instruction manual

**Results:**

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

*PREPARED AND CHECKED BY:*  
For and On Behalf of **WELLAB Ltd.**

  
**PATRICK TSE**  
Laboratory Manager

## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

Test Report No.:	C/N/100907/3
Date of Issue:	2010-09-07
Date Received:	2010-09-06
Date Tested:	2010-09-06
Date Completed:	2010-09-07
Next Due Date:	2011-09-06

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

Description	: 'SVANTEK' Integrating Sound Level Meter
Manufacturer	: SVANTEK
Model No.	: SVAN 957
Serial No.	: 21460
Microphone No.	: 43679
Equipment No.	: N-08-09

**Test conditions:**

Room Temperature	: 23 degree Celsius
Relative Humidity	: 65%

**Test Specifications:**

Performance checking at 94 and 114 dB

**Methodology:**

In-house method, according to manufacturer instruction manual

**Results:**

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**

  
\_\_\_\_\_  
**PATRICK TSE**  
Laboratory Manager

## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

Test Report No.:	C/N/100924/2
Date of Issue:	2009-09-24
Date Received:	2010-09-22
Date Tested:	2010-09-22
Date Completed:	2010-09-24
Next Due Date:	2011-09-23

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Item for calibration:

Description	: Acoustical Calibrator
Manufacturer	: SVANTEK
Model No.	: SV30A
Serial No.	: 10929
Equipment No.	: N-09-01

### Test conditions:

Room Temperature	: 22 degree Celsius
Relative Humidity	: 59%

### Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

### Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**

  
\_\_\_\_\_  
**PATRICK TSE**  
Laboratory Manager

## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

Test Report No.:	C/N/91109/1
Date of Issue:	2009-11-09
Date Received:	2009-11-07
Date Tested:	2009-11-07
Date Completed:	2009-11-09
Next Due Date:	2010-11-08

**ATTN:** Mr. Henry Leung

Page: 1 of 1

**Item for calibration:**

Description : Acoustical Calibrator  
Manufacturer : SVANTEK  
Model No. : SV30A  
Serial No. : 10965  
Equipment No. : N-09-02

**Test conditions:**

Room Temperature : 21 degree Celsius  
Relative Humidity : 55%

**Methodology:**

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

**Results:**

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**

  
\_\_\_\_\_  
**PATRICK TSE**  
*Laboratory Manager*



## Calibration Certificate

Number: CCP/60118

Customer Name: China Harbour Engineering Co; Ltd  
Address: 19/F, China Harbour Building,  
370-374 King's Road, North Point.  
Hong Kong.  
Contact Person: Mr. Cheung  
Detector Model: Crowcon Custodian CDL Portable Gas Detector  
Serial Number: 24800 37076

---

Sensor Type	Measuring Range	Alarm Level Settings				Test Gas	Result
		Alarm 1	Alarm 2	STEL	LTEL		
CH4	0 to 100%LEL	20	40	NA	NA	50%LEL	Passed
H2S	0 to 25ppm	5	10	10	5	25ppm	Passed
O2	0 to 25%v/v	19.5	23.0	NA	NA	18.5%v/v	Passed
CO	0 to 250ppm	25	100	200	30	200ppm	Passed

Next Calibration Date: 12<sup>th</sup> Aug 2011

### Remarks:

1. "Passed" refers to the detector has been successfully calibrated to meet with manufacturer tolerance of the instrument & sensor specification and repeatability  $\pm 5\%$  FSD.
2. The above equipment has been tested and calibrated in accordance with procedures referred to in Crowcon's BSI validated ISO9001 quality manual. Test equipment used has been factory calibrated and is traceable to national standards. Canned calibration gas has been prepared in accordance with BS4559 and original gas mixture has been prepared using NPL (UK) certified Gravimetric Standard. Gas generator has been tested to meet with: Mil Std 45662A / ANSI/NCSL Z540-1

Authorized Signature

Date: 13/08/2010



FireMark Hong Kong Limited  
Unit 901, 9/F., Lai Sun Commercial Center, 680 Cheung Sha Wan Road, Kowloon,  
Hong Kong

Tel : (852) 2751 8871 Fax : (852) 2751 8806



---

---

**APPENDIX C  
ENVIRONMENTAL MONITORING  
SCHEDULE**

---

---

**Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B  
Impact Air Quality and Noise Monitoring Schedule for October 2010**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					<b>1-Oct</b>	2-Oct
<b>3-Oct</b>	4-Oct	5-Oct	6-Oct	7-Oct	8-Oct	9-Oct
	24 hr TSP	1 hr TSP	1 hr TSP Noise		1 hr TSP 24 hr TSP	
<b>10-Oct</b>	11-Oct	12-Oct	13-Oct	14-Oct	15-Oct	<b>16-Oct</b>
	1 hr TSP			1 hr TSP Noise 24 hr TSP	1 hr TSP	
<b>17-Oct</b>	18-Oct	19-Oct	20-Oct	21-Oct	22-Oct	23-Oct
	1 hr TSP	1 hr TSP	24 hr TSP	1 hr TSP Noise		
<b>24-Oct</b>	25-Oct	26-Oct	27-Oct	28-Oct	29-Oct	30-Oct
	1 hr TSP	1 hr TSP Noise 24 hr TSP	1 hr TSP			

**Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B  
Tentative Impact Air Quality and Noise Monitoring Schedule for November 2010**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	1-Nov	2-Nov	3-Nov	4-Nov	5-Nov	6-Nov
	24 hr TSP	1 hr TSP		1 hr TSP Noise	1 hr TSP	24 hr TSP
<b>7-Nov</b>	8-Nov	9-Nov	10-Nov	11-Nov	12-Nov	13-Nov
	1 hr TSP		1 hr TSP	1 hr TSP Noise	24 hr TSP	
<b>14-Nov</b>	15-Nov	16-Nov	17-Nov	18-Nov	19-Nov	20-Nov
	1 hr TSP	1 hr TSP		24 hr TSP	1 hr TSP Noise	
<b>21-Nov</b>	22-Nov	23-Nov	24-Nov	25-Nov	26-Nov	27-Nov
	1 hr TSP		1 hr TSP 24 hr TSP	1 hr TSP Noise		
<b>28-Nov</b>	29-Nov	30-Nov				
		1 hr TSP 24 hr TSP				

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

---

---

**APPENDIX D  
1-HOUR TSP MONITORING RESULTS  
AND GRAPHICAL PRESENTATION**

---

---

## Appendix D - 1-hour TSP Monitoring Results

### Station CAM1

### Government Staff Quarters

Date	Sampling Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Conc. (µg/m <sup>3</sup> )
					Initial	Final		Initial	Final		Initial	Final			
5-Oct-10	09:30	Cloudy	297.3	763.7	3.2004	3.2067	0.0063	14765.1	14766.1	1.0	1.23	1.23	1.23	73.7	86
6-Oct-10	09:00	Sunny	296.4	763.8	3.1700	3.1741	0.0041	14766.1	14767.1	1.0	1.23	1.23	1.23	73.8	56
8-Oct-10	09:00	Sunny	298.3	761.8	3.1448	3.1515	0.0067	14767.1	14768.1	1.0	1.22	1.22	1.22	73.5	91
11-Oct-10	09:00	Cloudy	298.5	761.8	3.1428	3.1479	0.0051	14792.1	14793.1	1.0	1.22	1.22	1.22	73.4	69
14-Oct-10	09:00	Sunny	300.1	762.1	3.1797	3.1928	0.0131	14793.1	14794.1	1.0	1.22	1.22	1.22	73.3	179
15-Oct-10	15:00	Cloudy	298.8	761.3	3.1705	3.1781	0.0076	14818.1	14819.1	1.0	1.22	1.22	1.22	73.4	104
18-Oct-10	09:00	Sunny	303.0	763.0	3.1736	3.1797	0.0061	14819.1	14820.1	1.0	1.22	1.22	1.22	73.0	84
19-Oct-10	10:30	Sunny	298.1	761.8	3.1961	3.2043	0.0082	14820.1	14821.1	1.0	1.23	1.22	1.22	73.5	112
21-Oct-10	10:30	Cloudy	298.1	757.1	3.1644	3.1769	0.0125	14845.1	14846.1	1.0	1.22	1.22	1.22	73.3	171
25-Oct-10	09:00	Sunny	297.3	761.5	3.1992	3.2055	0.0063	14846.1	14847.1	1.0	1.23	1.23	1.23	73.6	86
26-Oct-10	09:00	Sunny	295.0	757.7	3.1788	3.1832	0.0044	14847.1	14848.1	1.0	1.23	1.23	1.23	73.7	60
27-Oct-10	13:00	Sunny	294.4	766.5	3.2027	3.2145	0.0118	14872.1	14873.1	1.0	1.24	1.24	1.24	74.1	159
														Min	56
														Max	179
														Average	105

### Station CAM2

### Heng Hing Printing Centre

Date	Sampling Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Conc. (µg/m <sup>3</sup> )
					Initial	Final		Initial	Final		Initial	Final			
5-Oct-10	09:30	Cloudy	297.3	763.7	3.1740	3.1822	0.0082	23942.2	23943.2	1.0	1.22	1.22	1.22	73.0	112
6-Oct-10	09:00	Sunny	296.4	763.8	3.1941	3.1994	0.0053	23943.2	23944.2	1.0	1.22	1.22	1.22	73.1	72
8-Oct-10	09:00	Sunny	298.2	761.8	3.1651	3.1720	0.0069	23944.2	23945.2	1.0	1.21	1.21	1.21	72.8	95
11-Oct-10	09:00	Cloudy	298.5	761.8	3.1540	3.1629	0.0089	23969.2	23970.2	1.0	1.21	1.21	1.21	72.8	122
14-Oct-10	09:00	Sunny	300.1	762.1	3.1903	3.1961	0.0058	23970.2	23971.2	1.0	1.21	1.21	1.21	72.6	80
15-Oct-10	15:00	Cloudy	298.8	761.3	3.1681	3.1762	0.0081	23995.2	23996.2	1.0	1.21	1.21	1.21	72.8	111
18-Oct-10	09:00	Sunny	303.0	763.0	3.1420	3.1507	0.0087	23996.2	23997.2	1.0	1.21	1.21	1.21	72.4	120
19-Oct-10	10:45	Sunny	298.1	761.8	3.2078	3.2190	0.0112	23997.2	23998.2	1.0	1.21	1.21	1.21	72.9	154
21-Oct-10	10:30	Cloudy	298.1	757.1	3.2193	3.2292	0.0099	24022.2	24023.2	1.0	1.21	1.21	1.21	72.7	136
25-Oct-10	09:00	Sunny	297.3	761.5	3.1733	3.1815	0.0082	24023.2	24024.2	1.0	1.22	1.22	1.22	72.9	112
26-Oct-10	09:00	Sunny	295.0	757.7	3.1722	3.1795	0.0073	24024.2	24025.2	1.0	1.22	1.22	1.22	73.0	100
27-Oct-10	13:00	Sunny	294.4	766.5	3.1766	3.1917	0.0151	24049.2	24050.2	1.0	1.22	1.22	1.22	73.5	206
														Min	72
														Max	206
														Average	118




## Appendix D - 1-hour TSP Monitoring Results

Station CAM3

Talcon Industrial Ltd

Date	Sampling Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Conc. (µg/m <sup>3</sup> )
					Initial	Final		Initial	Final		Initial	Final			
5-Oct-10	Cloudy	Sunny	297.3	763.7	3.1656	3.1744	0.0088	17205.9	17206.9	1.0	1.23	1.23	1.23	73.8	119
6-Oct-10	Sunny	Sunny	296.4	763.8	3.1691	3.1758	0.0067	17206.9	17207.9	1.0	1.23	1.23	1.23	73.9	91
8-Oct-10	Sunny	Sunny	298.2	761.8	3.1380	3.1465	0.0085	17207.9	17208.9	1.0	1.23	1.23	1.23	73.6	115
11-Oct-10	Cloudy	Cloudy	298.5	761.8	3.1642	3.1745	0.0103	17232.9	17233.9	1.0	1.23	1.23	1.23	73.6	140
14-Oct-10	Sunny	Cloudy	300.1	762.1	3.1990	3.2060	0.0070	17233.9	17234.9	1.0	1.22	1.22	1.22	73.4	95
15-Oct-10	Cloudy	Cloudy	298.8	761.3	3.1601	3.1706	0.0105	17258.9	17259.9	1.0	1.23	1.22	1.23	73.5	143
18-Oct-10	Sunny	Sunny	303.0	763.0	3.1764	3.1859	0.0095	17259.9	17260.9	1.0	1.22	1.22	1.22	73.1	130
19-Oct-10	Sunny	Sunny	298.1	761.8	3.2068	3.2215	0.0147	17260.9	17261.9	1.0	1.23	1.23	1.23	73.6	200
21-Oct-10	Cloudy	Cloudy	298.1	757.1	3.1784	3.1935	0.0151	17285.9	17286.9	1.0	1.22	1.22	1.22	73.4	206
25-Oct-10	Sunny	Cloudy	297.3	761.5	3.1808	3.1905	0.0097	17286.9	17287.9	1.0	1.23	1.23	1.23	73.7	132
26-Oct-10	Sunny	Cloudy	295.0	757.7	3.1727	3.1815	0.0088	17287.9	17288.9	1.0	1.23	1.23	1.23	73.8	119
27-Oct-10	Sunny	Sunny	294.4	766.5	3.1751	3.1876	0.0125	17312.9	17313.9	1.0	1.24	1.24	1.24	74.3	168
														Min	91
														Max	206
														Average	138

### 1-hr TSP Concentration Levels

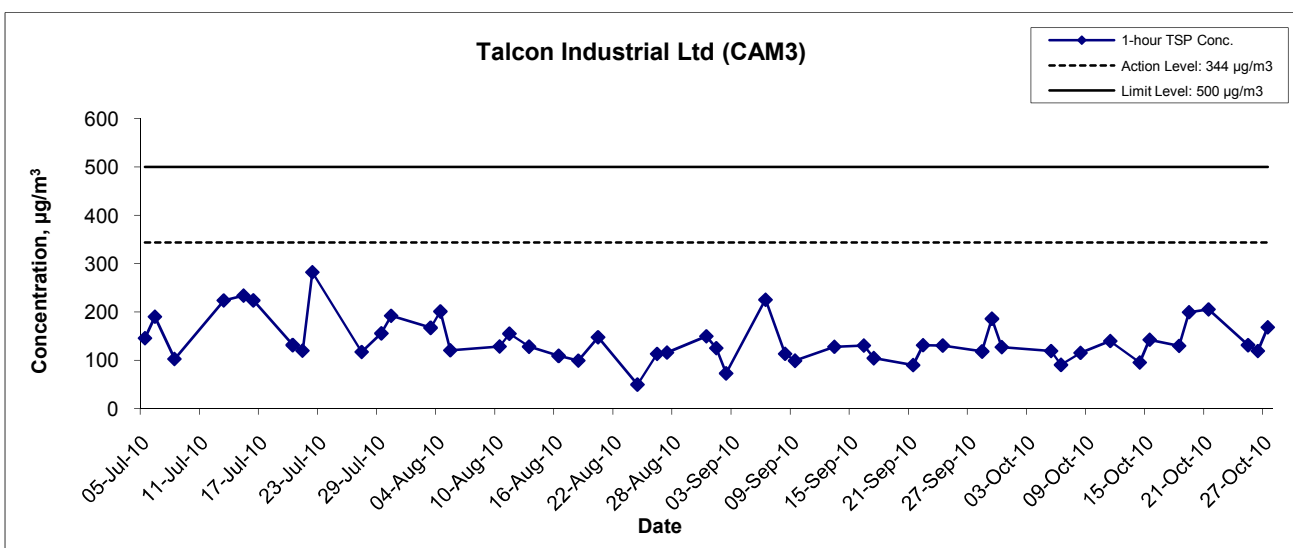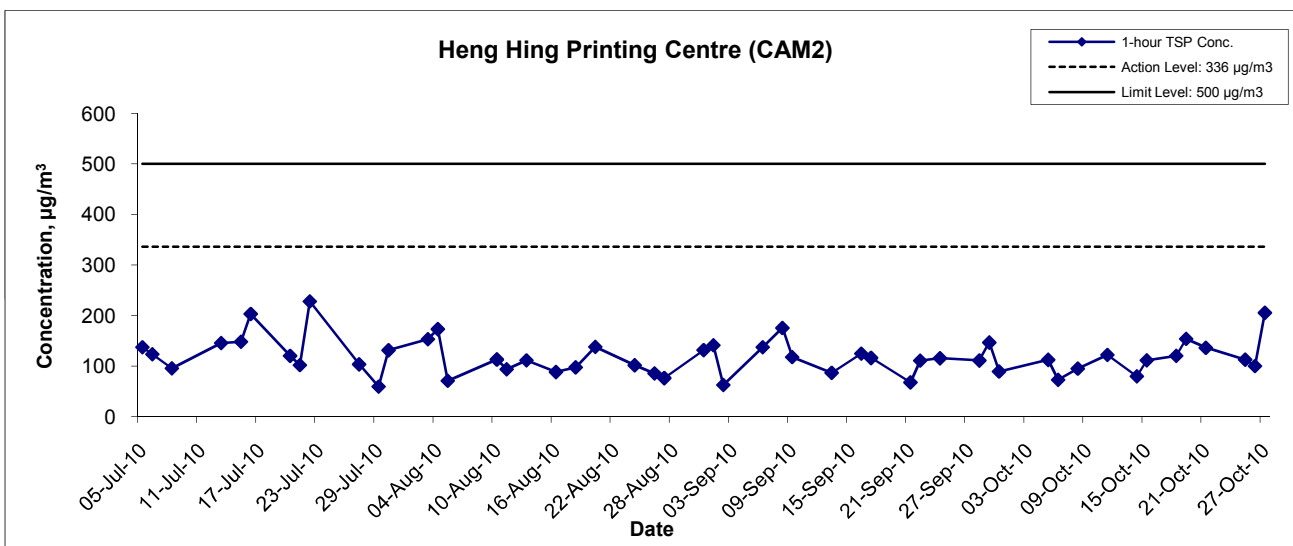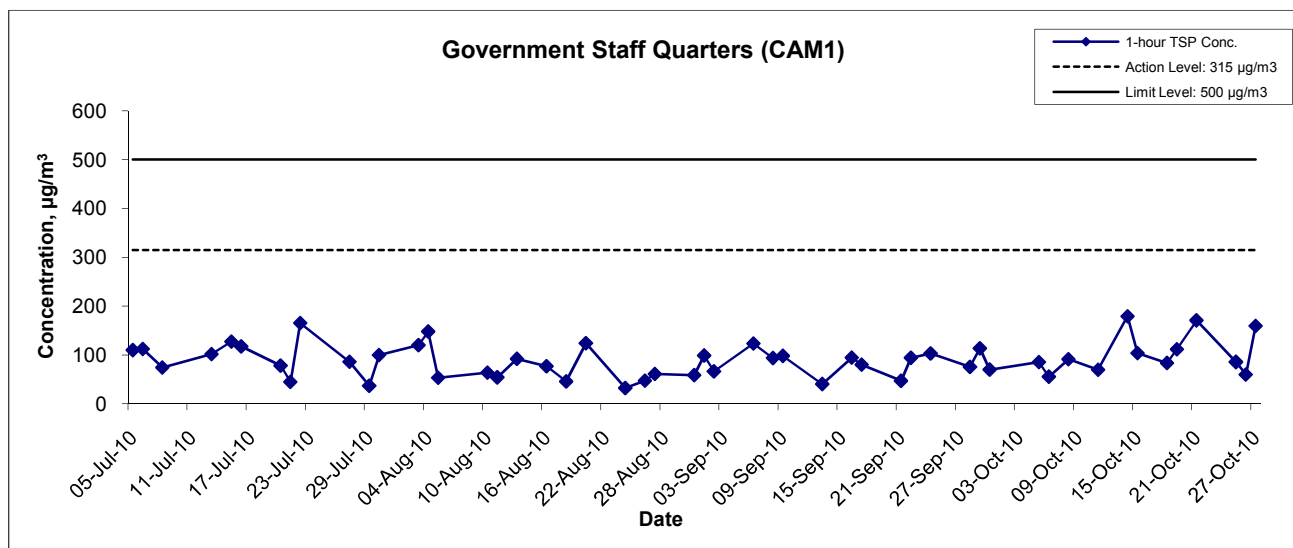

Title	Contract No. DC/2009/09	Scale	Project No.	CINOTECH
	Construction of Tai Po Sewage Treatment Works - Stage V Phase II B	N.T.S	MA0010	
Graphical Presentation of 1-hour TSP Impact Monitoring Results		Date	Appendix	
		Oct 10	D	

---

---

**APPENDIX E  
24-HOUR TSP MONITORING RESULTS  
AND GRAPHICAL PRESENTATION**

---

---



## Appendix E - 24-hour TSP Monitoring Results

### Station CAM1 Government Staff Quarters

Start Date	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Conc. (µg/m <sup>3</sup> )
				Initial	Final		Initial	Final		Initial	Final			
4-Oct-10	Cloudy	298.3	763.2	3.1825	3.2360	0.0535	14741.1	14765.1	24.0	1.23	1.23	1.23	1764.6	30
8-Oct-10	Sunny	300.2	759.6	3.2016	3.2727	0.0711	14768.1	14792.1	24.0	1.22	1.22	1.22	1755.4	41
14-Oct-10	Sunny	302.3	769.6	3.1827	3.2568	0.0741	14794.1	14818.1	24.0	1.22	1.22	1.22	1760.4	42
20-Oct-10	Cloudy	297.9	758.8	3.2044	3.3341	0.1297	14821.1	14845.1	24.0	1.22	1.22	1.22	1760.9	74
26-Oct-10	Sunny	295.4	757.4	3.1945	3.3804	0.1859	14848.1	14872.1	24.0	1.23	1.23	1.23	1766.4	105
													Min	30
													Max	105
													Average	58




### Station CAM2 Heng Hing Printing Centre

Start Date	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Conc. (µg/m <sup>3</sup> )
				Initial	Final		Initial	Final		Initial	Final			
4-Oct-10	Cloudy	298.3	763.2	3.1810	3.2654	0.0844	23918.2	23942.2	24.0	1.22	1.21	1.21	1749.5	48
8-Oct-10	Sunny	300.2	759.6	3.2223	3.2951	0.0728	23945.2	23969.2	24.0	1.21	1.21	1.21	1740.7	42
14-Oct-10	Sunny	302.3	769.6	3.1807	3.2627	0.0820	23971.2	23995.2	24.0	1.21	1.21	1.21	1745.5	47
20-Oct-10	Cloudy	297.9	758.8	3.1765	3.3586	0.1821	23998.2	24022.2	24.0	1.21	1.21	1.21	1746.0	104
26-Oct-10	Sunny	295.4	757.4	3.1988	3.3626	0.1638	24025.2	24049.2	24.0	1.22	1.22	1.22	1751.2	94
													Min	42
													Max	104
													Average	67

### Station CAM3 Talcon Industrial Ltd

Start Date	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m <sup>3</sup> /min.)		Av. flow (m <sup>3</sup> /min)	Total vol. (m <sup>3</sup> )	Conc. (µg/m <sup>3</sup> )
				Initial	Final		Initial	Final		Initial	Final			
4-Oct-10	Cloudy	298.3	763.2	3.1736	3.2591	0.0855	17181.9	17205.9	24.0	1.23	1.23	1.23	1768.0	48
8-Oct-10	Sunny	300.2	759.6	3.1912	3.2711	0.0799	17208.9	17232.9	24.0	1.22	1.22	1.22	1758.4	45
14-Oct-10	Sunny	302.3	769.6	3.1977	3.3044	0.1067	17234.9	17258.9	24.0	1.22	1.22	1.22	1763.6	61
20-Oct-10	Cloudy	297.9	758.8	3.1835	3.4029	0.2194	17261.9	17285.9	24.0	1.23	1.22	1.23	1764.2	124
26-Oct-10	Sunny	295.4	757.4	3.1791	3.3907	0.2116	17288.9	17312.9	24.0	1.23	1.23	1.23	1769.9	120
													Min	45
													Max	124
													Average	80

### 24-hr TSP Concentration Levels

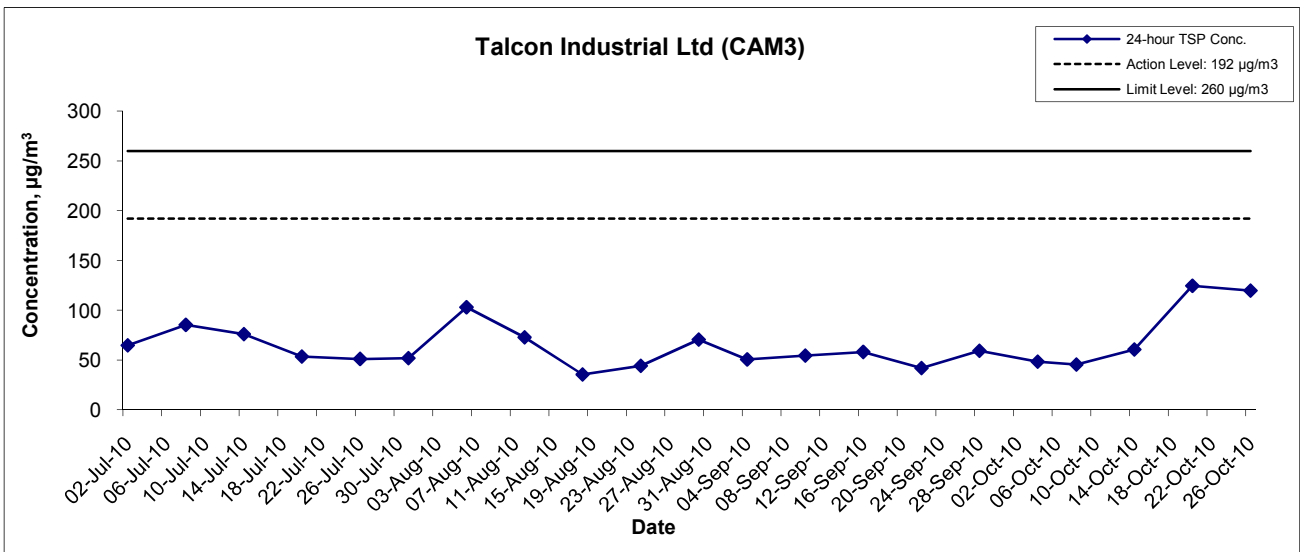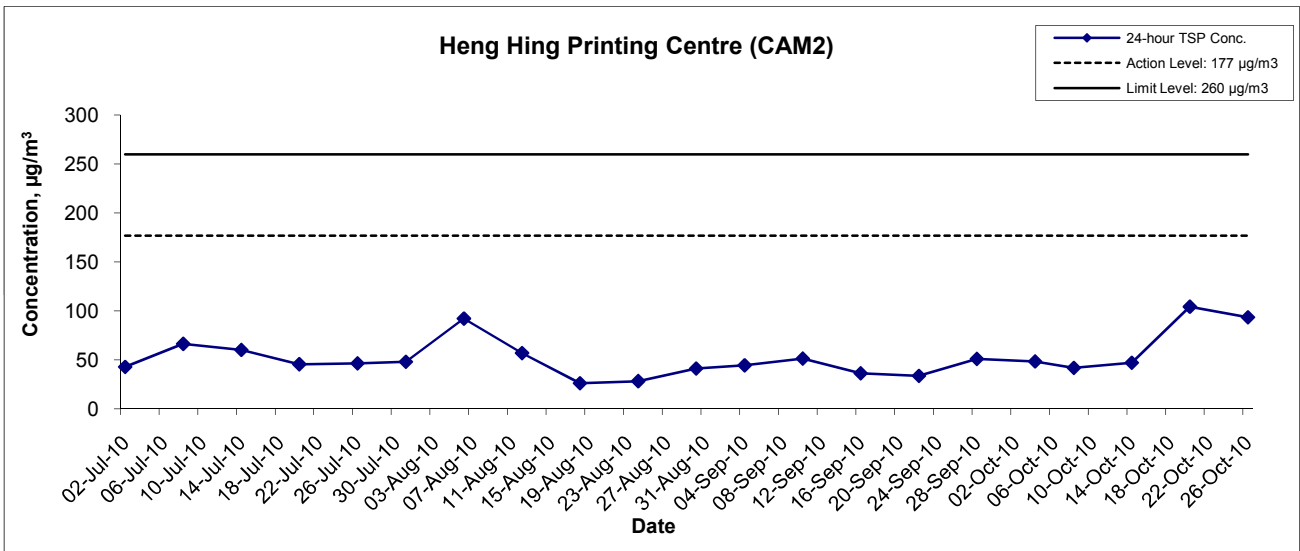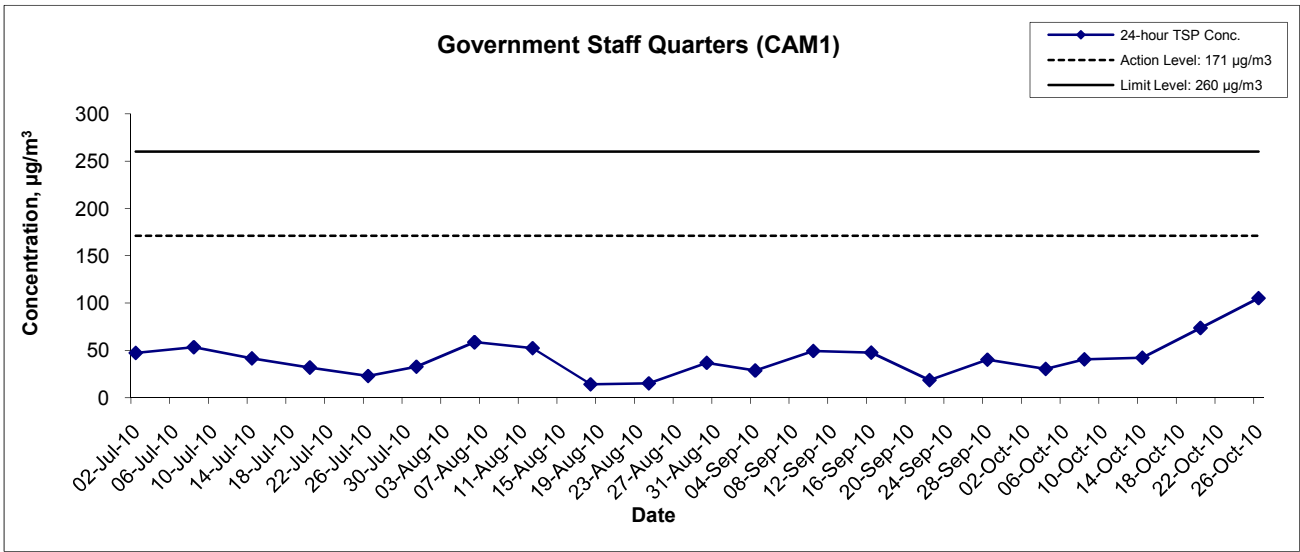

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of 24-hour TSP Impact Monitoring Results	Scale	Project No.		
		N.T.S		MA0010
	Date	Oct 10		Appendix E

---

---

**APPENDIX F  
NOISE MONITORING RESULTS AND  
GRAPHICAL PRESENTATION**


---

---

## Appendix F - Noise Monitoring Results

Location NM1 - Government Staff Quarters					
Date	Time	Weather	dB (A) (30-min)		
			L <sub>eq</sub>	L <sub>10</sub>	L <sub>90</sub>
6-Oct-10	11:15	Fine	66.3	68.7	62.2
14-Oct-10	10:20	Sunny	68.3	69.5	66.0
21-Oct-10	09:00	Cloudy	67.3	69.8	65.5
26-Oct-10	13:35	Sunny	63.8	65.5	59.5
		Average	66.7	68.7	64.0
		Minimum	63.8	65.5	59.5
		Maximum	68.3	69.8	66.0

## Noise Levels

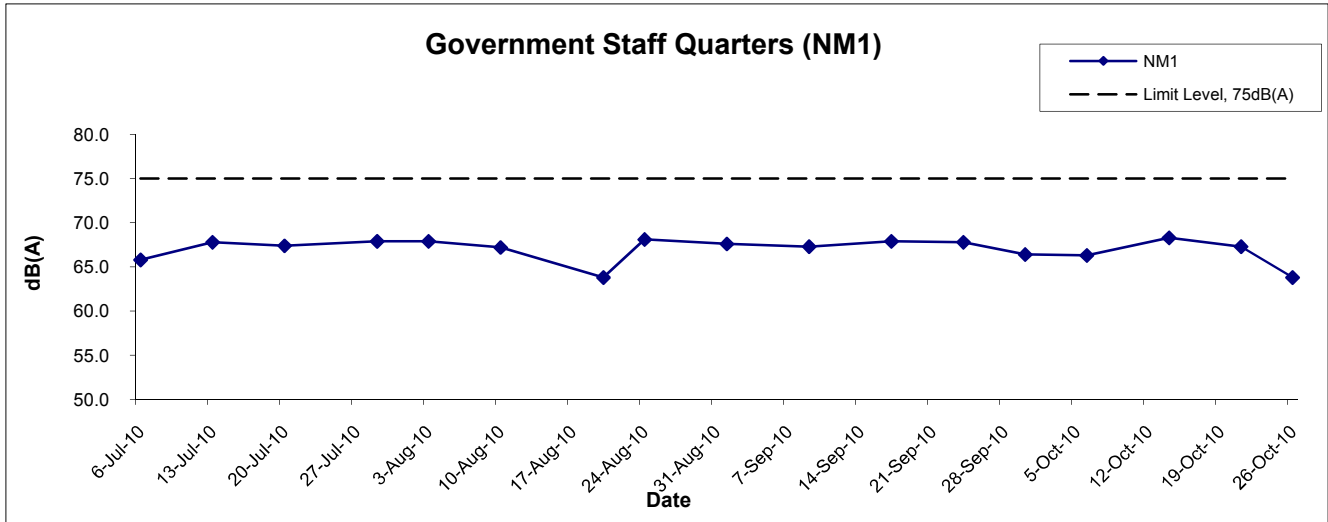

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA0010	
	Date Oct 10	Appendix F	

---

---

**APPENDIX G  
RECORDS OF LANDFILL GAS  
MEASUREMENT BY THE  
CONTRACTOR**





---

---

**APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR**

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
FC11B and FC12B	2-Oct-10	8:30 AM	79.1	0	0	20.9
	2-Oct-10	1:30 PM	79.1	0	0	20.9
	4-Oct-10	8:30 AM	79.1	0	0	20.9
	4-Oct-10	1:30 PM	79.1	0	0	20.9
	5-Oct-10	8:30 AM	79.1	0	0	20.9
	5-Oct-10	1:30 PM	79.1	0	0	20.9
	6-Oct-10	8:30 AM	79.1	0	0	20.9
	6-Oct-10	1:30 PM	79.1	0	0	20.9
	7-Oct-10	8:30 AM	79.1	0	0	20.9
	7-Oct-10	1:30 PM	79.1	0	0	20.9
	8-Oct-10	8:30 AM	79.1	0	0	20.9
	8-Oct-10	1:30 PM	79.1	0	0	20.9
	9-Oct-10	8:30 AM	79.1	0	0	20.9
	9-Oct-10	1:30 PM	79.1	0	0	20.9
	11-Oct-10	8:30 AM	79.1	0	0	20.9
	11-Oct-10	1:30 PM	79.1	0	0	20.9
	12-Oct-10	8:30 AM	79.1	0	0	20.9
	12-Oct-10	1:30 PM	79.1	0	0	20.9
	13-Oct-10	8:30 AM	79.1	0	0	20.9
	13-Oct-10	1:30 PM	79.1	0	0	20.9
	14-Oct-10	8:30 AM	79.1	0	0	20.9
	14-Oct-10	1:30 PM	79.1	0	0	20.9
	15-Oct-10	8:30 AM	79.1	0	0	20.9
	15-Oct-10	1:30 PM	79.1	0	0	20.9
	18-Oct-10	8:30 AM	79.1	0	0	20.9
	18-Oct-10	1:30 PM	79.1	0	0	20.9
	19-Oct-10	8:30 AM	79.1	0	0	20.9
	19-Oct-10	1:30 PM	79.1	0	0	20.9
	20-Oct-10	8:30 AM	79.1	0	0	20.9
	20-Oct-10	1:30 PM	79.1	0	0	20.9
21-Oct-10	8:30 AM	79.1	0	0	20.9	
21-Oct-10	1:30 PM	79.1	0	0	20.9	
22-Oct-10	8:30 AM	79.1	0	0	20.9	
22-Oct-10	1:30 PM	79.1	0	0	20.9	
23-Oct-10	8:30 AM	79.1	0	0	20.9	
23-Oct-10	1:30 PM	79.1	0	0	20.9	
25-Oct-10	8:30 AM	79.1	0	0	20.9	
25-Oct-10	1:30 PM	79.1	0	0	20.9	
26-Oct-10	8:30 AM	79.1	0	0	20.9	
26-Oct-10	1:30 PM	79.1	0	0	20.9	
27-Oct-10	8:30 AM	79.1	0	0	20.9	
27-Oct-10	1:30 PM	79.1	0	0	20.9	
28-Oct-10	8:30 AM	79.1	0	0	20.9	
28-Oct-10	1:30 PM	79.1	0	0	20.9	
29-Oct-10	8:30 AM	79.1	0	0	20.9	
29-Oct-10	1:30 PM	79.1	0	0	20.9	
30-Oct-10	8:30 AM	79.1	0	0	20.9	
30-Oct-10	1:30 PM	79.1	0	0	20.9	





### Balance Gas

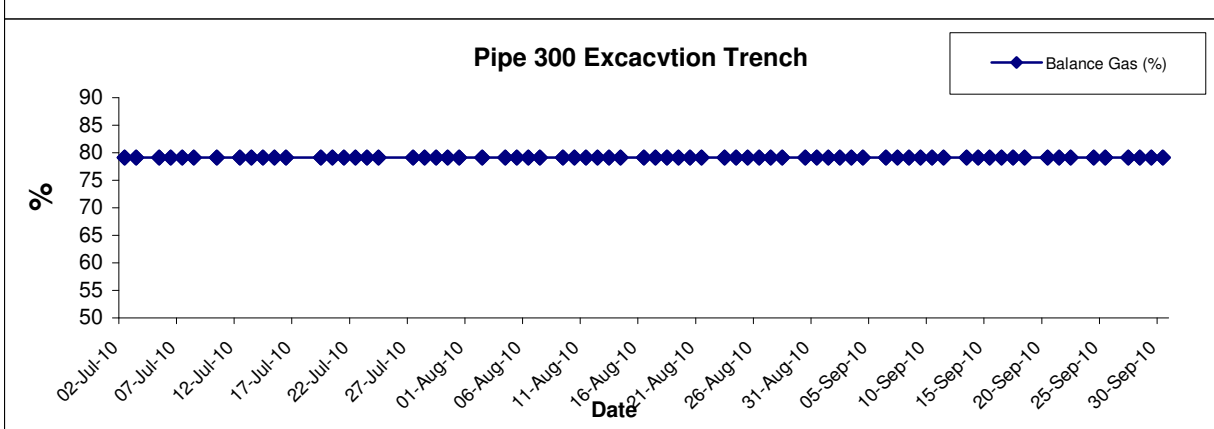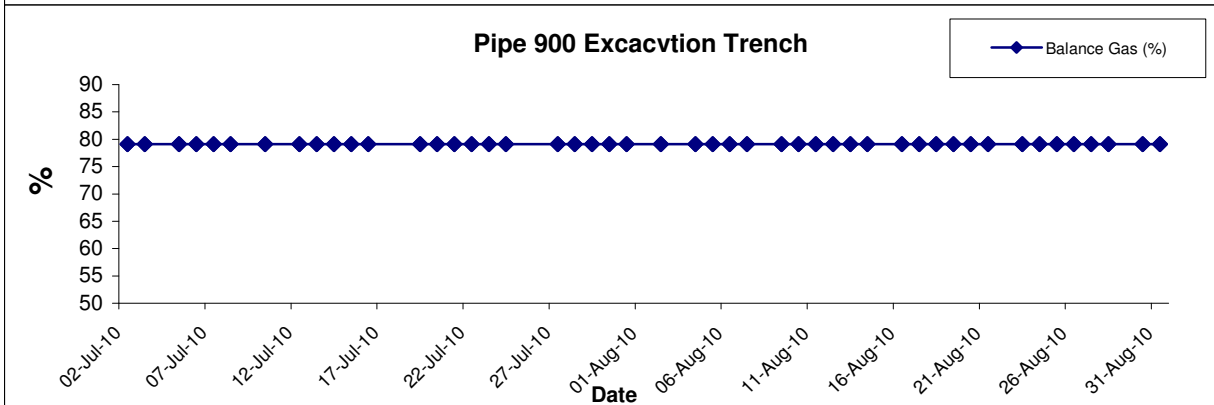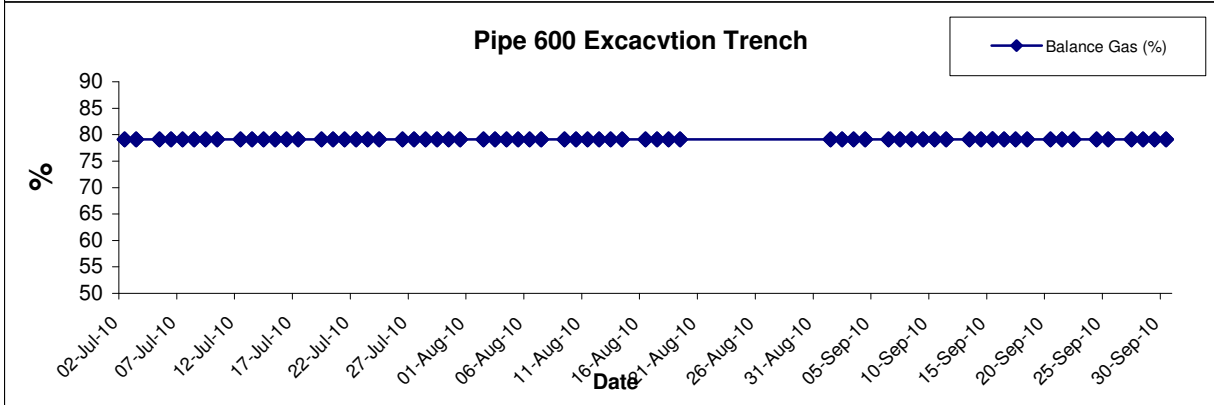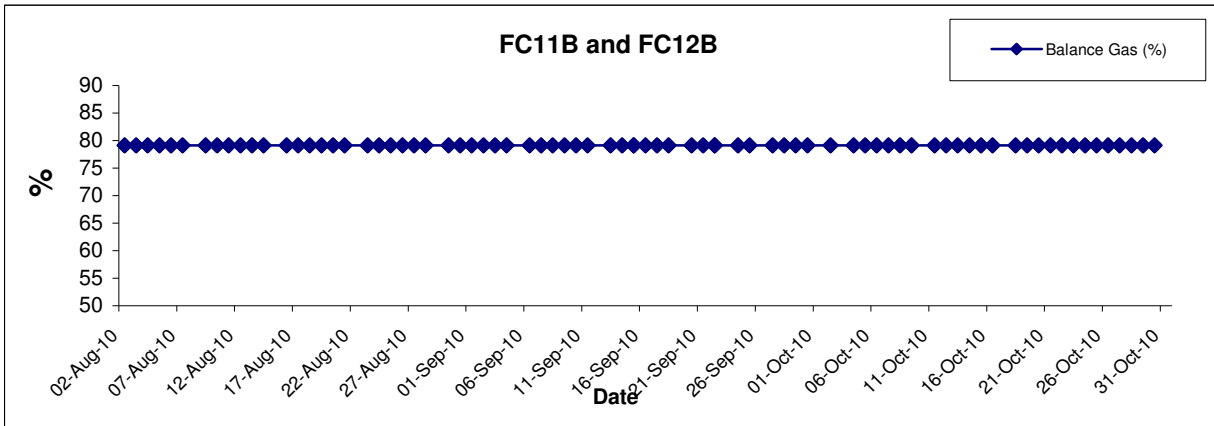

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of Landfill Gas Measurement	Scale N.T.S	Project No. MA0010	<b>CINOTECH</b>
	Date Oct 10	Appendix G	







### Combustible Gas (Methane)

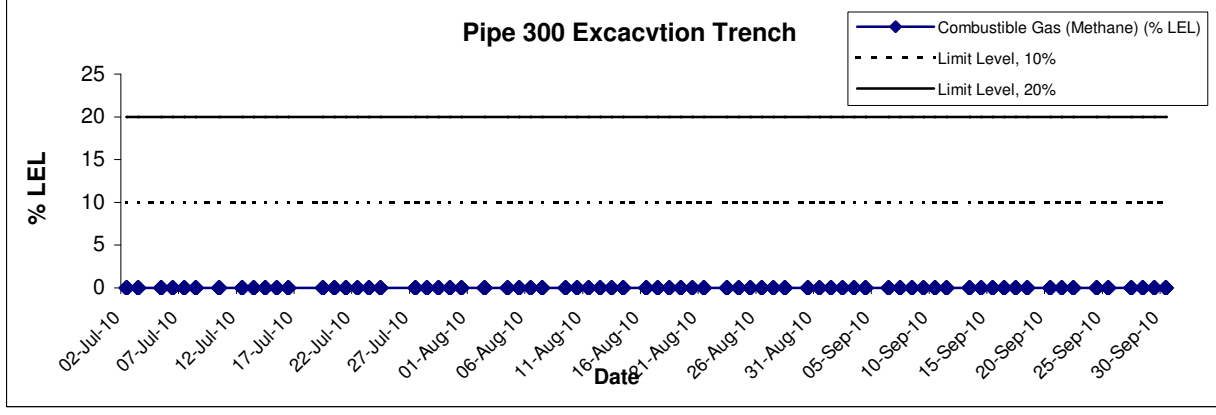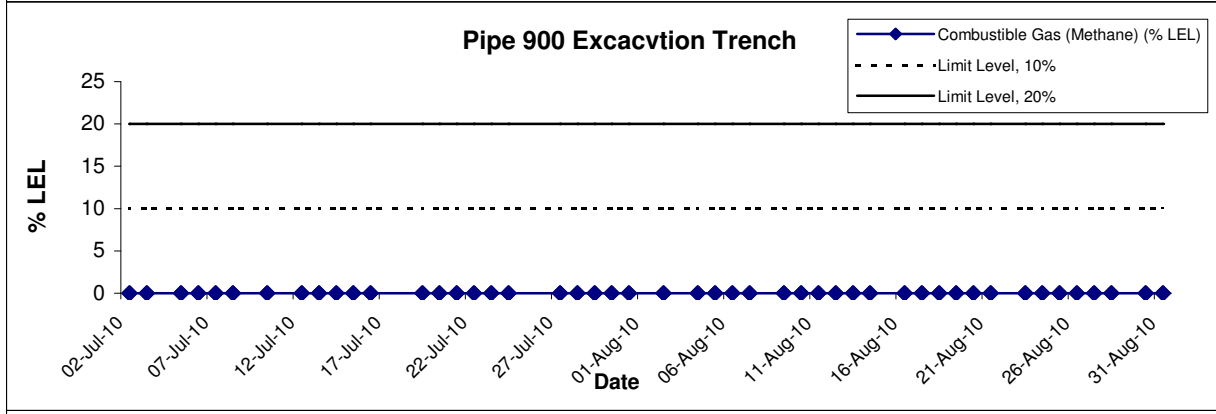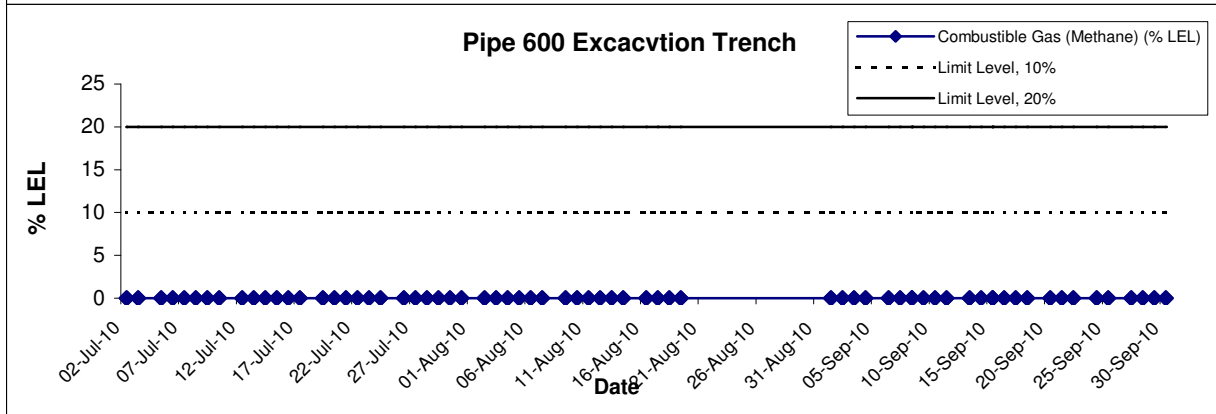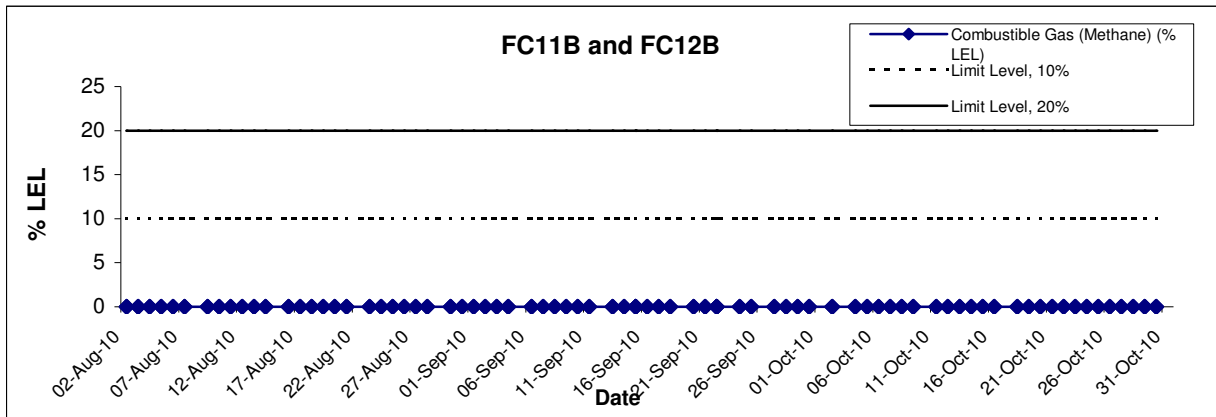





Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B  Graphical Presentation of Landfill Gas Measurement	Scale N.T.S	Project No. MA0010	CINOTECH
	Date Oct 10	Appendix G	

### Carbon Dioxide

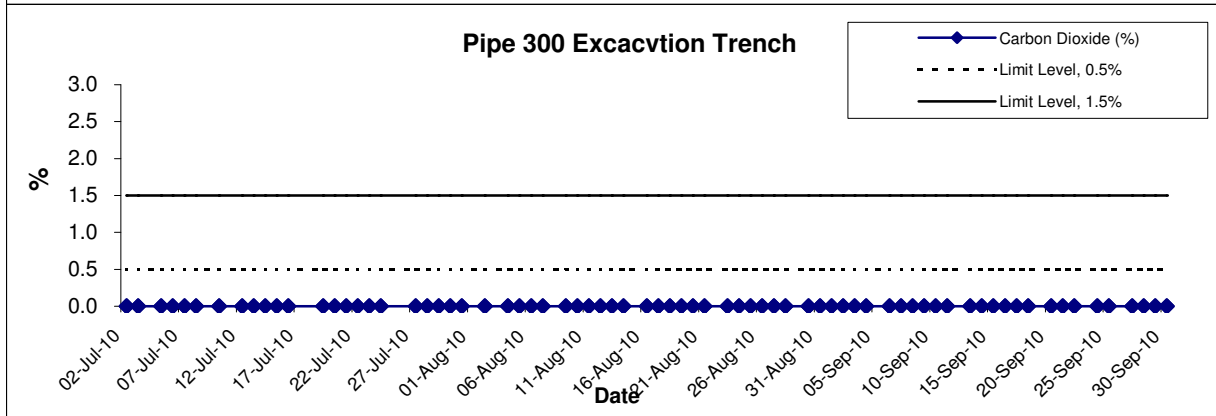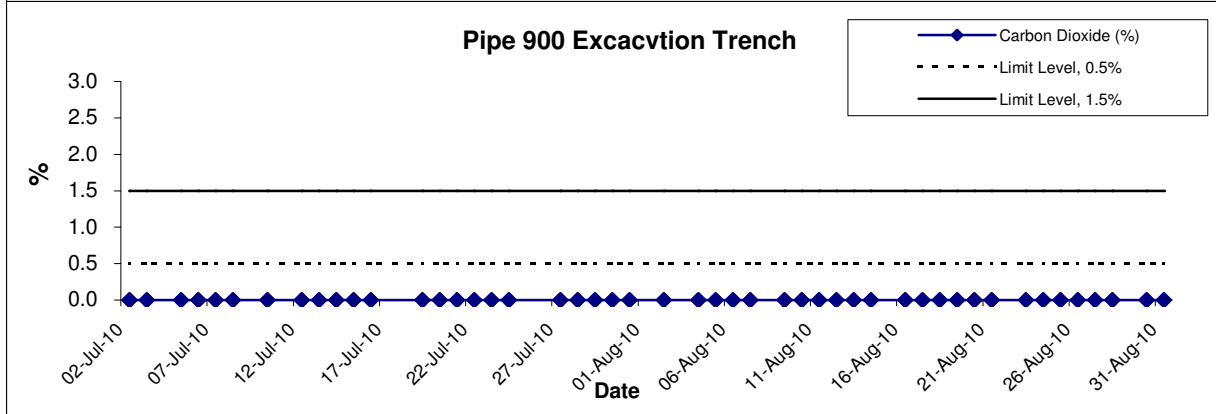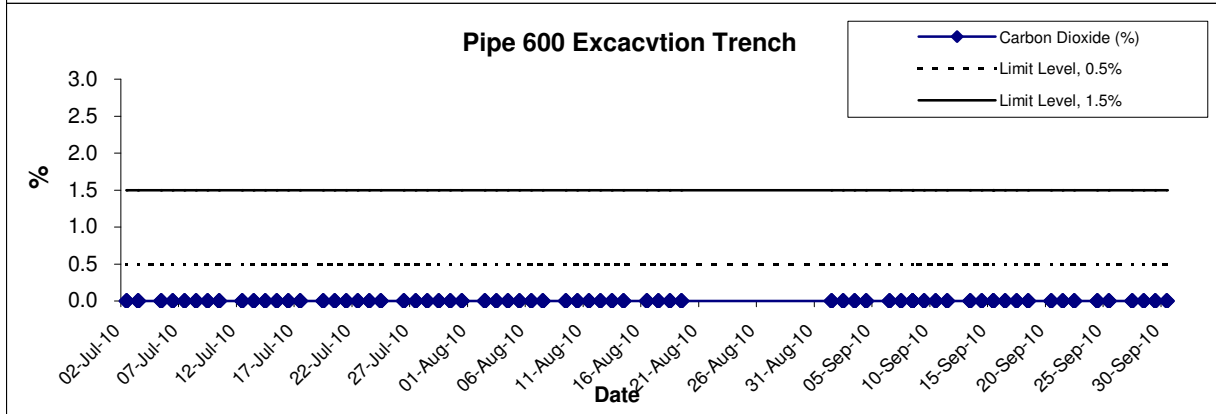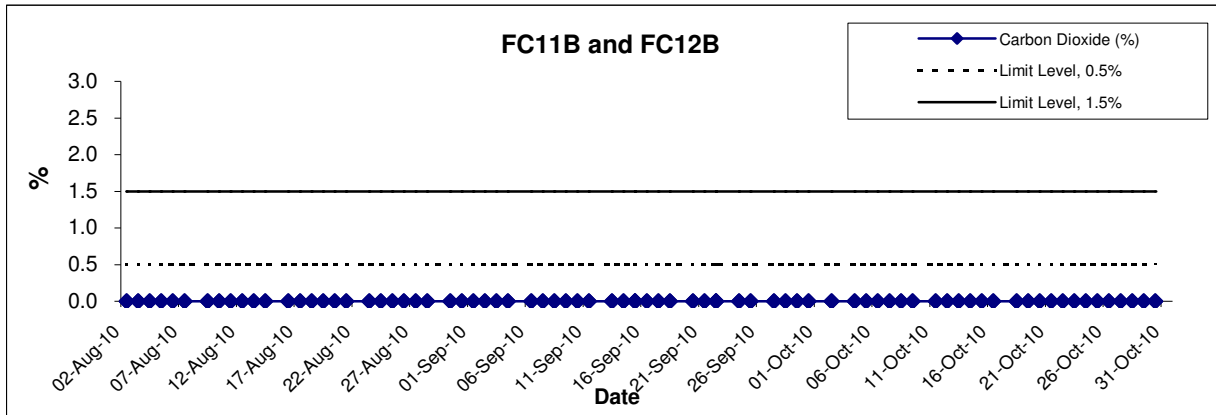

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B  Graphical Presentation of Landfill Gas Measurement	Scale N.T.S	Project No. MA0010	CINOTECH
	Date Oct 10	Appendix G	

## Oxygen

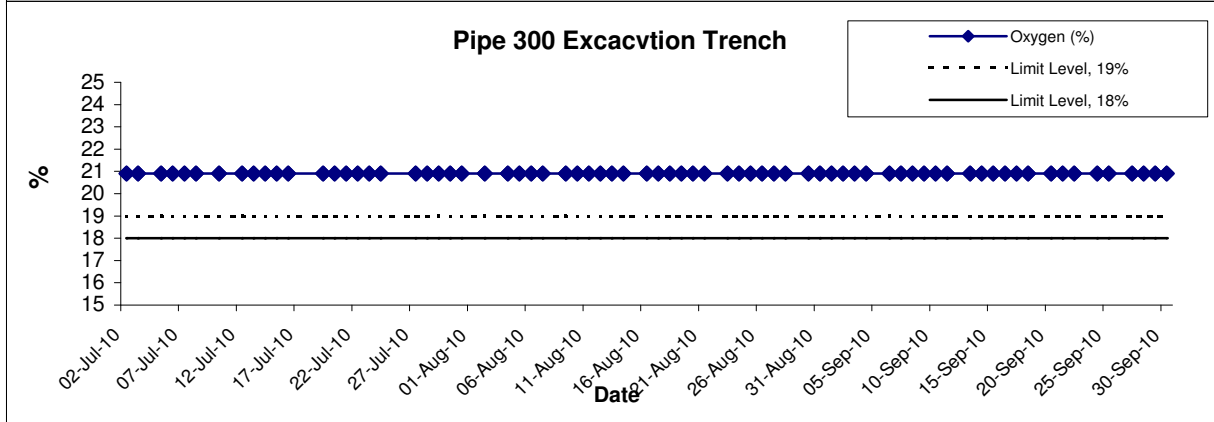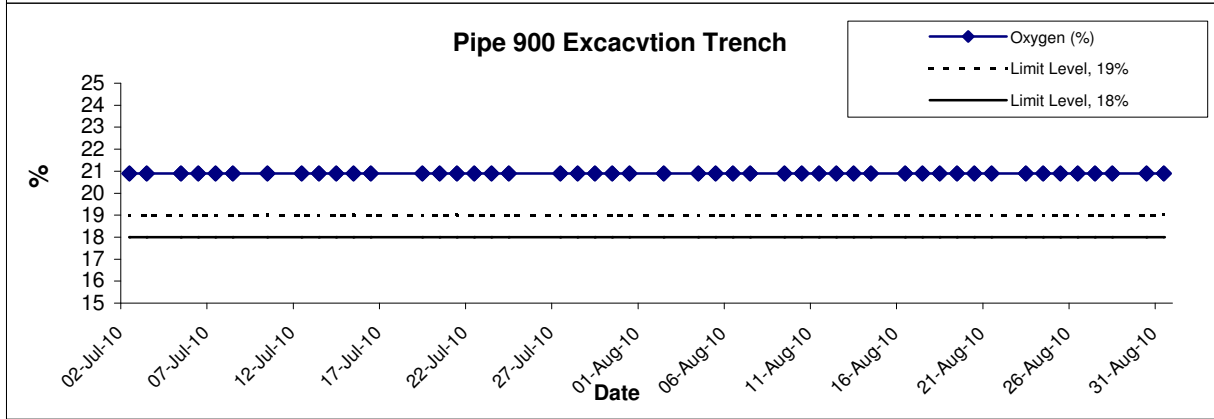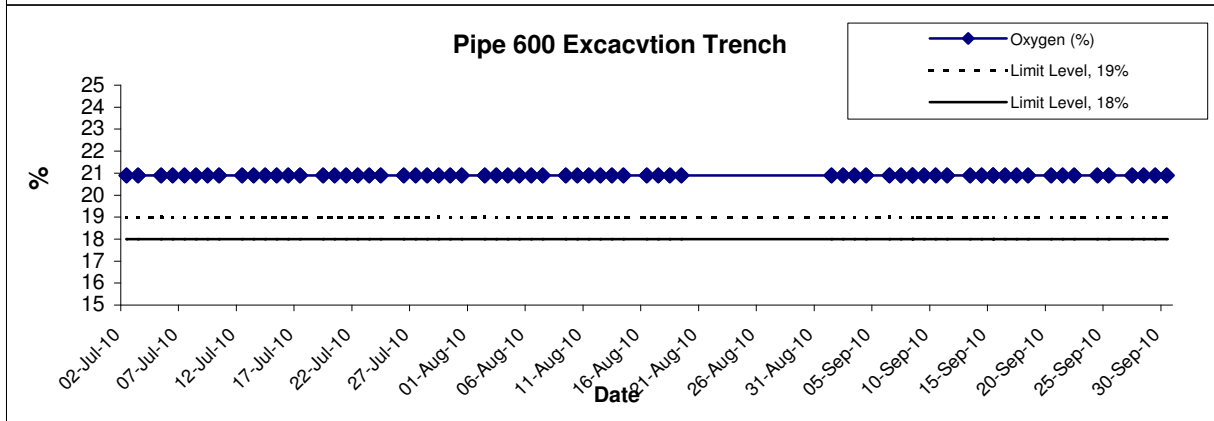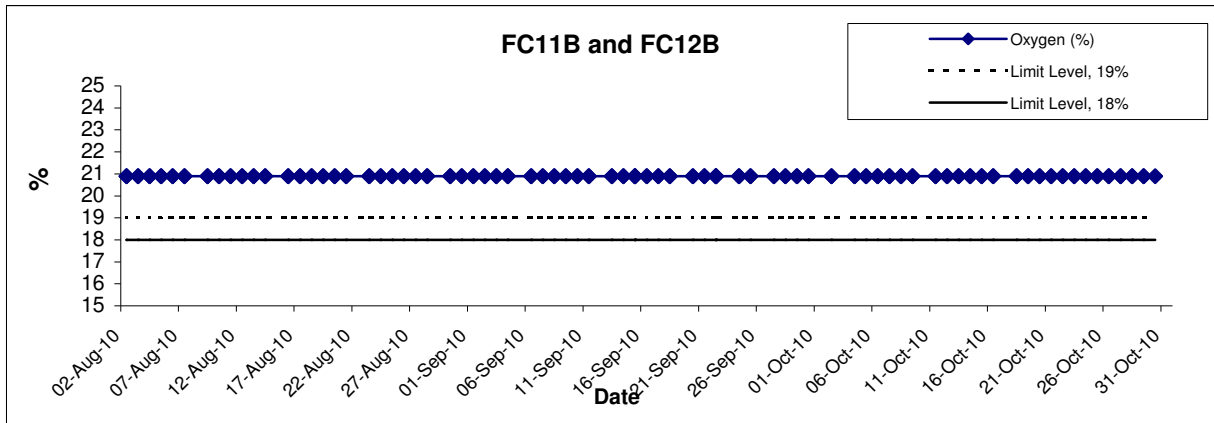

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B  Graphical Presentation of Landfill Gas Measurement	Scale	N.T.S	Project No. MA0010	CINOTECH
	Date	Oct 10	Appendix G	

---

---

**APPENDIX H  
SUMMARY OF EXCEEDANCE**

---

---

## **APPENIDX H – SUMMARY OF EXCEEDANCE**

**Reporting Month:** October 2010

*a) Exceedance Report for 1-hr TSP (NIL)*

*b) Exceedance Report for 24-hr TSP (NIL)*

*c) Exceedance Report for Construction Noise (NIL)*

*d) Exceedance Report for Landfill Gas (NIL)*

---

---

**APPENDIX I  
SITE AUDIT SUMMARY**

---

---



Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	101008
Date	8 <sup>th</sup> October 2010 (Friday)
Time	15:00-16:00

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The Contractor was reminded to reinforce with bund near the u-channel at near tank 7.</li> </ul>	
101008-R01	<ul style="list-style-type: none"> <li>The Contractor was reminded to cover with impervious material at stockpile at Sludge Sediment Tank and Biogas Holding Tank.</li> </ul>	B1
101008-R02	<ul style="list-style-type: none"> <li>Deposited mud should be cleared at soaking pit at A-Tank 5 and 6.</li> </ul>	C7
101008-R03		E6
	<p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>Follow-up on the previous audit sessions (Ref. No.100928), all environmental deficiencies have been Improved/ rectified during site inspection.</p>	

	Name	Signature	Date
Recorded by	TY Yeung		8 October 2010
Checked by	Dr. Priscilla Choy		8 October 2010

Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	101014
Date	14 <sup>th</sup> October 2010 (Thursday)
Time	9:30-10:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
101014-R01	<p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>Stagnant water was observed within the drip tray. The Contractor was reminded to clear it.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.101008), all environmental deficiencies have been Improved/ rectified during site inspection.</p>	B12

	Name	Signature	Date
Recorded by	TY Yeung		14 October 2010
Checked by	Dr. Priscilla Choy		14 October 2010



Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	101021
Date	21 <sup>st</sup> October 2010 (Thursday)
Time	9:30-10:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
101021-R01	<p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>General refuse should be stored within the recycling bin at tank 11 and 12.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.101014), all environmental deficiencies have been Improved/ rectified during site inspection.</p>	E1iii.

	Name	Signature	Date
Recorded by	TY Yeung		21 October 2010
Checked by	Dr. Priscilla Choy		21 October 2010

Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	101028
Date	28 <sup>th</sup> October 2010 (Thursday)
Time	10:00-11:00

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
101028-R01 101028-R02	<p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The Contractor was reminded to water the site regularly.</li> <li>The general refuse should be cleared at A-Tank.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> <li>Follow-up on the previous audit sessions (Ref. No.101021), item 101021-R01 at Tank 11 and 12 was not observed during the site inspection. Follow-up is needed at next site audit.</li> </ul>	C5 E1iii.

	Name	Signature	Date
Recorded by	TY Yeung		28 October 2010
Checked by	Dr. Priscilla Choy		28 October 2010

---

---

**APPENDIX J**  
**EVENT ACTION PLANS**

---

---

**APPENDIX J (1) – Event Action Plan for Air Quality Monitoring (Construction Phase)**

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
<b><i>ACTION LEVEL</i></b>				
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform IEC and ER;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	<ol style="list-style-type: none"> <li>Notify Contractor.</li> </ol>	<ol style="list-style-type: none"> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>Identify source;</li> <li>Inform IC(E) and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>
<b><i>LIMIT LEVEL</i></b>				
1. Exceedance for one sample	<ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform Contractor, IEC, ER, and EPD;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ol>	<ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals; 4. Amend proposal if appropriate.</li> </ol>
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

**APPENDIX J (2) – Event Action Plan for Construction Noise Monitoring (Construction Phase)**

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
<b><i>ACTION LEVEL</i></b>	<ol style="list-style-type: none"> <li>1. Notify IEC and Contractor;</li> <li>2. Carry out investigation;</li> <li>3. Report the results of investigation to the IEC, ER and Contractor;</li> <li>4. Discuss with the Contractor and formulate remedial measures;</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol style="list-style-type: none"> <li>1. Review the analyzed results submitted by the ET;</li> <li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analyzed noise problem;</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>	<ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC;</li> <li>2. Implement noise mitigation proposals.</li> </ol>
<b><i>LIMIT LEVEL</i></b>	<ol style="list-style-type: none"> <li>1. Identify source;</li> <li>2. Inform IEC, ER, EPD and Contractor;</li> <li>3. Repeat measurements to confirm findings;</li> <li>4. Increase monitoring frequency;</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>6. Inform IEC, ER and EPD the causes and actions taken for the exceedances;</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol>	<ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>	<ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>3. Implement the agreed proposals;</li> <li>4. Resubmit proposals if problem still not under control;</li> <li>5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

**APPENDIX J (3) – Event Action Plan for Landfill Gas Monitoring (Construction Phase)**

<b>Parameter</b>	<b>Limit Level</b>	<b>Action Required</b>
Oxygen	<19%	Ventilate to restore oxygen to >19%
	<18%	Stop works; Evacuate personnel / prohibit entry; Increase ventilation to restore oxygen to > 19%
Methane	>10% LEL (i.e. >0.5% by volume)	Post “no smoking signs; Prohibit hot works; Ventilate to restore methane to <10% LEL
	>20% LEL (i.e. >1% by volume)	Stop works; Evacuate personnel / prohibit entry; Increase ventilation to restore methane to <10% LEL
Carbon Dioxide	>0.5%	Ventilate to restore carbon dioxide to <0.5%
	>1.5%	Stop works; Evacuate personnel / prohibit entry; Increase ventilation to restore carbon dioxide to <0.5%

---

---

**APPENDIX K  
UPDATED ENVIRONMENTAL  
MITIGATION IMPLEMENTATION  
SCHEDULE**

---

---

**APPENDIX K – Updated Environmental Mitigation Implementation Schedule  
(During Construction Phase)**

Type of Impact	Recommended Mitigation Measures	Status
<b>Air Quality</b>	Dust mitigation measures stipulated in <i>the Air Pollution Control (Construction Dust) Regulation</i> shall be incorporated to control dust emission. Notice shall be given to authority prior to commencing of work	√
<b>Noise</b>	Use of quiet PME	N/A
	<p>Good Site Practice</p> <ul style="list-style-type: none"> <li>• Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program;</li> <li>• Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program;</li> <li>• Mobile plant, if any, should be sited as far from NSRs as possible;</li> <li>• Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>• Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and</li> <li>• Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities.</li> </ul>	√
<b>Water Quality</b>	The practices outlined in ProPECC PN 1/94 Construction Site Drainage should be adopted to minimize the potential water quality impacts from construction site runoff and various construction activities. The recommendation to install perimeter drains to collect site runoff and to properly treat the runoff by settlement tank/treatment system shall apply to all sites including those for mainlaying works. Minimum distances of 100 m should be maintained between the discharge points of construction site runoff and the existing WSD saltwater intake at Tai Po.	√
	A discharge licence needs to be applied from EPD for discharging effluent from the construction site. The discharge quality is required to meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies with all the standards listed in the TM. Reuse and recycling of the treated effluent can minimize water consumption and reduce the effluent discharge volume. The beneficial uses of the treated effluent may include dust suppression, wheel washing and general cleaning. Monitoring of the discharge quality of treated effluent should be part of the Environmental Monitoring and Audit (EM&A) programme. Detailed effluent sampling programme for water quality control during construction phase should be submitted to EPD, AFCD and WSD for approval prior to commencement of the construction works.	√
	The construction programme should be properly planned to minimize soil excavation, if any, in rainy seasons. This prevents soil erosion from exposed soil surfaces. Any exposed soil surfaces should also be properly protected to minimize dust emission. In areas where a large amount of exposed soils exist, earth bunds or sand bags should be provided. Exposed stockpiles should be covered with tarpaulin or impervious sheets at all time. The stockpiles of materials should be placed in the locations away from any stream courses so as to avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted and protected by permanent work. It is suggested that haul roads should be paved with concrete and the temporary access roads are protected using crushed stone or gravel, wherever practicable. Wheel washing facilities should be provided at all site exits to ensure that earth, mud and debris would not be carried out of the works areas by vehicles.	√
	Good site practices should be adopted to clean the rubbish and litter on the construction sites so as to prevent the rubbish and litter from dropping into the nearby environment. It is recommended to clean the construction sites on a regular basis.	√



Type of Impact	Recommended Mitigation Measures	Status
	It is recommended to provide sufficient chemical toilets in the works areas. The toilet facilities should not be less than 30 m from any watercourse. A licensed waste collector should be deployed to clean the chemical toilets on a regular basis. The construction workers can also make use of the existing toilet facilities within the TPSTW as necessary.	√
	Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the project. Implementation of environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site.	√
	It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	√
	Any service shop and minor maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken with the areas appropriately equipped to control these discharges.	√
	<p>Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows:</p> <ul style="list-style-type: none"> <li>• Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport</li> <li>• Chemical waste containers should be suitably labelled to notify and warn the personnel who are handling the wastes to avoid accidents.</li> <li>• Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area.</li> </ul>	√
	Marine water quality monitoring should be carried out under emergency condition or during maintenance of the THEES tunnel to verify the findings of the water quality modelling. It is recommended that the maintenance of the THEES tunnel, if unavoidable, should be conducted during winter season or low flow periods and to avoid the “blooming” season of algae (normally from April to June) if practicable. Details of the monitoring requirements are specified in the EM&A Manual.	N/A

Type of Impact	Recommended Mitigation Measures	Status
<b>Waste Management</b>	Good site practices during the construction activities include: <ul style="list-style-type: none"> <li>• Nomination of approved personnel, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.</li> <li>• Training of site personnel in proper waste management and chemical waste handling procedures.</li> <li>• Provision of sufficient waste disposal points and regular collection for disposal.</li> <li>• Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.</li> <li>• Separation of chemical wastes for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> <li>• Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors.</li> <li>• A Waste Management Plan shall be prepared and this WMP shall be submitted to the Engineer for approval. One may make reference to ETWB TCW No. 15/2003 for details.</li> <li>• In order to monitor the disposal of C&amp;D materials at landfills and public filling areas, and to control fly tipping, a trip-ticket system shall be included as one of the contractual requirements and implemented by an Environmental Team undertaking the Environmental Monitoring and Audit work. One may make reference to WBTC No. 21/2002 for details.</li> <li>• A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) shall be proposed.</li> </ul>	√
	Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include: <ul style="list-style-type: none"> <li>• Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> <li>• To encourage collection of aluminum cans by individual collectors, separate labelled bins shall be provided to segregate this waste from other general refuse generated by the work force.</li> <li>• Any unused chemicals or those with remaining functional capacity shall be recycled.</li> <li>• Maximize the use of reusable steel formwork to reduce the amount of C&amp;D material.</li> <li>• Prior to disposal of C&amp;D waste, it is recommended that wood, steel and other metals shall be separated for re-use and / or recycling to minimize the quantity of waste to be disposed of to landfill.</li> <li>• Proper storage and site practices to minimize the potential for damage or contamination of construction materials.</li> <li>• Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste.</li> <li>• Minimize over ordering of concrete, mortars and cement grout by doing careful check before ordering</li> </ul>	√
	<b>General Refuse</b> General refuse shall be stored in enclosed bins or compaction units separate from C&D material. A reputable waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D material. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material.	√
	<b>Construction &amp; Demolition (C&amp;D) Material</b> C&D material generated from the site formation and demolition works shall be sorted on-site into inert C&D material (i.e. public fill) and C&D waste. In order to minimise the impact resulting from collection and transportation of C&D material for off-site disposal, the excavated material comprising fill material shall be reused on-site as backfilling material as far as practicable. C&D waste, such as wood, plastic, steel and other metals shall be reused or recycled and, as a last resort, disposed of to landfill. A suitable area shall be designated within the site for temporary stockpiling of C&D material and to facilitate the sorting process.	√

Type of Impact	Recommended Mitigation Measures	Status
	<p><i>Bentonite Slurry</i></p> <p>Bentonite slurries used in construction works should be reconditioned and reused wherever practicable. Residual used bentonite slurry should be disposed of from the site as soon as possible. The Contractor should explore alternative disposal outlets for the residual used bentonite slurry and disposal at landfill should be the last resort.</p>	N/A
<b>Landfill Gas Hazard</b>	<p>All personnel who work on the site and all visitors to the site should be aware of the possibility of ignition of gas in the vicinity of excavations. Safety notices should be displayed at prominent position around the site. Adequate fire extinguisher equipment and fire resistant clothing should be made available on site.</p>	√
	<p>Service runs within the consultation zone should be designated as “special routes” and utilities companies should be informed of this and should implement precautionary measures.</p>	√
	<p>Precautionary measures to minimize landfill gas hazard during excavation:</p> <ul style="list-style-type: none"> <li>• No smoking or burning shall be allowed</li> <li>• No worker shall work alone at any time in the confined space or any excavation trenches</li> <li>• Construction equipment shall be equipped with a vertical exhaust at least 0.6 m above ground level and /or with a park arrestors</li> <li>• Electrical motors and electrical extension cords shall be explosive-proof or intrinsically safe</li> <li>• Permit to Work procedures to be adopted for welding, flame cutting or other hot works in trenches or confined spaces</li> <li>• Forced ventilation if working in a trench deeper than 1 m</li> <li>• Close all valves immediately after piping assembly or conduiting construction. For the large diameter pipes, pipe end shall be capped on one side. Forced ventilation shall also be provided before commissioning of the pipeline and staff entering and working in it</li> <li>• Routine monitoring shall be conducted in all excavations to ensure the works area to be free of landfill gas before any man enters the area.</li> <li>• Landfill gas precautionary measures involved with excavation and piping works shall be included in the Safety Plan</li> <li>• Monitoring shall be conducted at the cracks on the ground floor during ground-works construction</li> </ul>	√
	<p>Where there are any temporary site offices, or any other buildings which have enclosed spaces with the capacity to accumulate landfill gas, then they should either:</p> <ul style="list-style-type: none"> <li>• be located on an area which has been proven to be free of landfill gas (by survey with portable gas detectors) and monitored manually by the Safety Officer or an approved wand appropriately qualified person to ensure that hazardous concentration of landfill gas does not occur; or</li> <li>• be raised clear of the ground. If buildings are raised clear of the ground, a minimum, clear separation (as measured from the highest point on the ground surface to the underside of lowest floor joist) should be 500mm</li> </ul>	√

**Note:**

- √ – Compliance of mitigation measures  
X – Non-compliance of mitigation measures  
N/A – Not applicable

---

---

**APPENDIX L  
WASTE GENERATION IN THE  
REPORTING MONTH**

---

---

**APPENDIX L – WASTE GENERATION IN THE REPORTING MONTH**

**Monthly Summary Waste Flow Table October 2010 (Year)**

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated	Broken Concrete (see Note 3)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastic (see Note 2)	Chemical Waste	Others, e.g. general refuse
	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m <sup>3</sup> )
Jan											
Feb											
Mar											
Apr											
May											
June											
Sub-total											
July	3.11	0	0	0	3.11	0	0	0	0	0	0.01
Aug	0.04	0	0	0	0.04	0	0	0	0	0	0
Sept	0.07	0	0	0	0.07	0	0	0	0	0	0.01
Oct	0.17	0	0	0	0.17	0	1.2	0	0	0	0.01
Nov											
Dec											
<b>Total</b>	<b>3.39</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>3.39</b>	<b>0</b>	<b>1.2</b>	<b>0</b>	<b>0</b>	<b>0</b>	<b>0.03</b>

- Notes:
- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
  - (2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
  - (3) Broken concrete for recycling into aggregates.

---

---

**APPENDIX M  
COMPLAINT LOG**

---

---

**APPENDIX M – COMPLAINT LOG****Reporting Month:** October 2010

<b>Log Ref.</b>	<b>Location</b>	<b>Received Date</b>	<b>Details of Complaint</b>	<b>Investigation/Mitigation Action</b>	<b>Status</b>
N/A	N/A	N/A	N/A	N/A	N/A

**Remarks:** No environmental complaint was received in the reporting month.

---


---

**APPENDIX N**  
**CONSTRUCTION PROGRAMME**

---

---



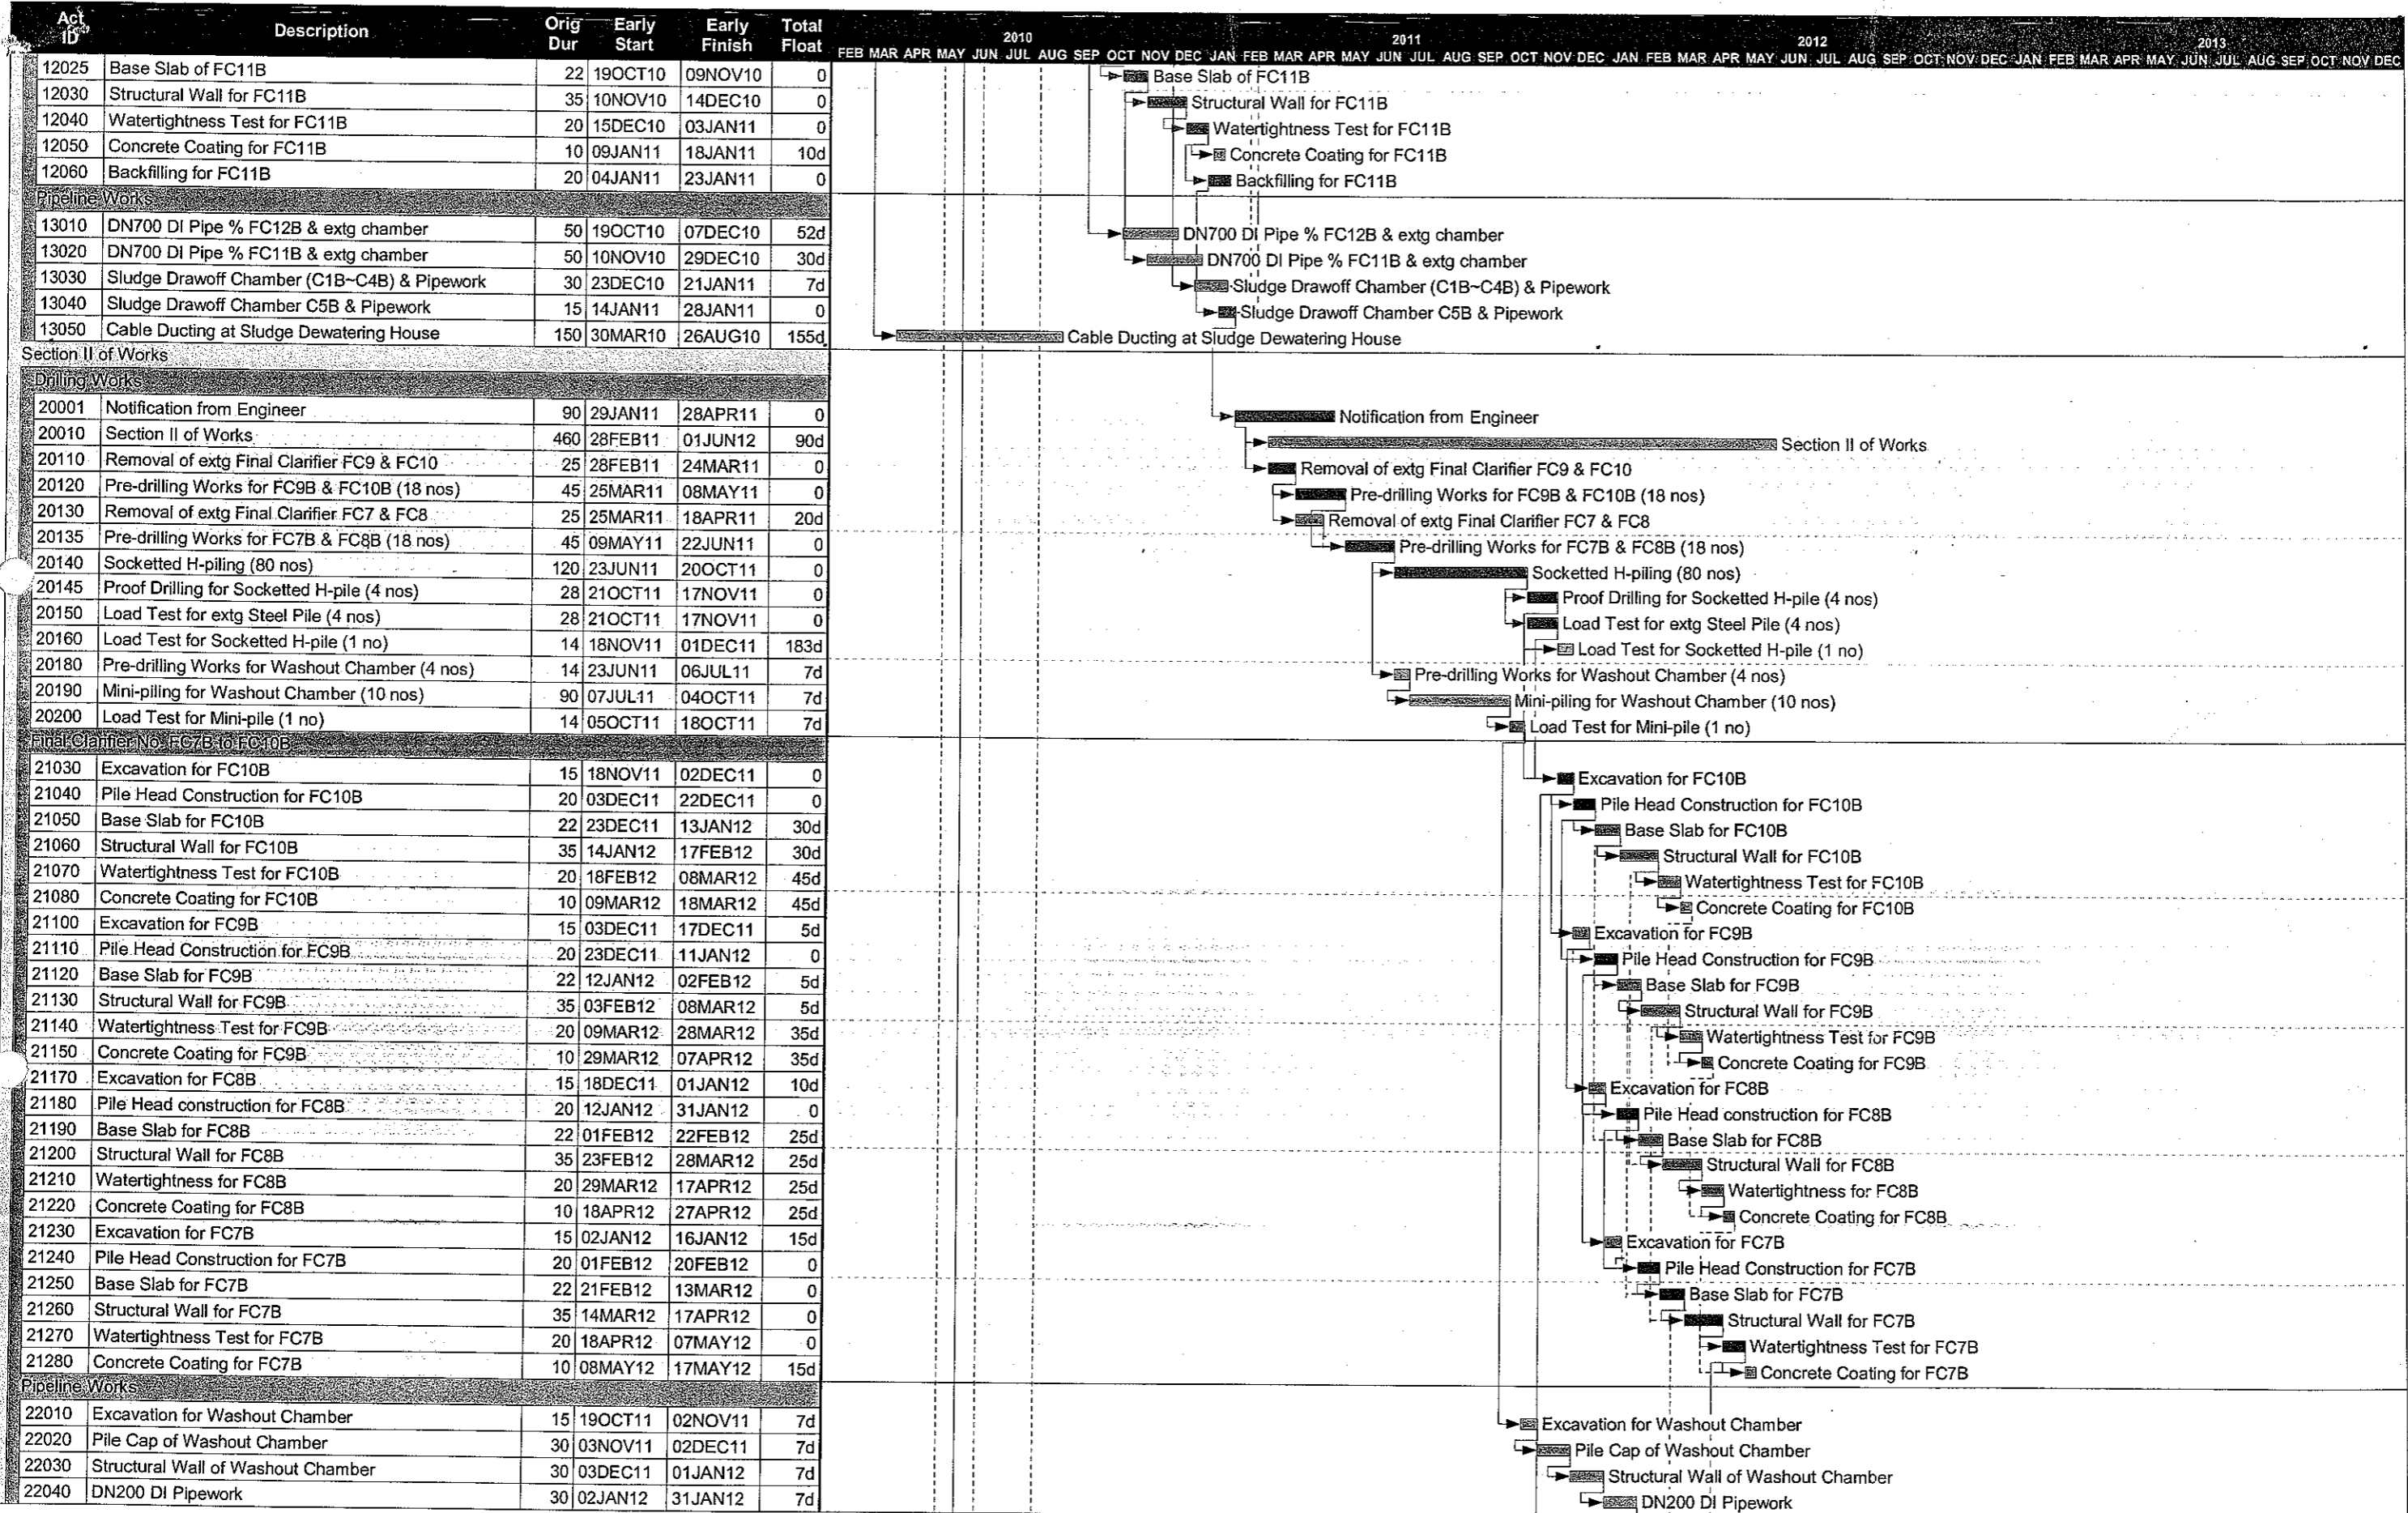

Start date 29JAN10  
 Finish date 27APR13  
 Data date 29JAN10  
 Run date 06APR10  
 Page number 2A  
 Primavera Systems, Inc.

Early bar  
 Progress bar  
 Critical bar  
 Summary bar  
 Start milestone point  
 Finish milestone point

**China Harbour Engineering Co. Ltd.**  
**TPSTW Stage 5 Phase 2B**

Date	Revision	Checked	Approved
05FEB10	0	WML	TKC
07APR10	1	AA	TKC


Act ID	Description	Orig Dur	Early Start	Early Finish	Total Float	2010												2011												2012												2013											
						FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	
<b>General</b>																																																					
Project Key Dates																																																					
1000	Possession of Site	0		28JAN10	1155d	Possession of Site																																															
10000	Completion of Section I of Works (365d)	0		28JAN11	790d	◆ Completion of Section I of Works (365d)																																															
20000	Completion of Section II of Works (460d)	0		01JUN12	330d	◆ Completion of Section II of Works (460d)																																															
30000	Completion of Section III of Works (670d)	0		28DEC11	486d	◆ Completion of Section III of Works (670d)																																															
40000	Completion of Section IV of Works (365d)	0		28JAN11	820d	◆ Completion of Section IV of Works (365d)																																															
50000	Completion of Section V of Works (1185d)	0		27APR13	0	◆ Completion of Section V of Works																																															
<b>Preliminary</b>																																																					
1010	Site Clearance	30	29JAN10	27FEB10	0	Site Clearance																																															
1020	Contractor Site Office Set-up	60	28FEB10	28APR10	84d	Contractor Site Office Set-up																																															
1030	Engineer's Accommodation	60	28FEB10	28APR10	1035d	Engineer's Accommodation																																															
1040	Initial Survey	60	29JAN10	29MAR10	25d	Initial Survey																																															
1050	Condition Survey	60	29JAN10	29MAR10	2d	Condition Survey																																															
1060	Environmental Baseline Monitoring	14	30MAR10	12APR10	1111d	Environmental Baseline Monitoring																																															
<b>Submission for Approval</b>																																																					
2010	Engineer's Green Roof	60	29APR10	27JUN10	1035d	Engineer's Green Roof																																															
2020	Excavation and Lateral Support (ELS)	30	29APR10	28MAY10	84d	Excavation and Lateral Support (ELS)																																															
2030	Project Signboard	30	29APR10	28MAY10	1065d	Project Signboard																																															
2040	Pile Load Test Set-up	30	30MAR10	28APR10	2d	Pile Load Test Set-up																																															
2050	Falsewk & Fwk for Pile Cap	30	29MAY10	27JUN10	90d	Falsewk & Fwk for Pile Cap																																															
2060	Falsewk & Fwk for Wall Structure	30	28JUN10	27JUL10	90d	Falsewk & Fwk for Wall Structure																																															
2070	Falsewk & Fwk for Top Slab	30	28JUL10	26AUG10	840d	Falsewk & Fwk for Top Slab																																															
2080	Multi-part Cover	45	27AUG10	10OCT10	840d	Multi-part Cover																																															
2090	FRP Handrail, Stair & Floor	45	11OCT10	24NOV10	840d	FRP Handrail, Stair & Floor																																															
2100	FRP Cover	30	11OCT10	09NOV10	900d	FRP Cover																																															
2110	Aluminium Flooring	45	25NOV10	08JAN11	840d	Aluminium Flooring																																															
2120	Green Roof System at Sludge Dewatering House	60	29APR10	27JUN10	310d	Green Roof System at Sludge Dewatering House																																															
2130	Green Roof System at Transformer House	60	29APR10	27JUN10	1035d	Green Roof System at Transformer House																																															
<b>Material Fabrication &amp; Delivery</b>																																																					
3010	Casing for Mini-pile	55	29APR10	22JUN10	173d	Casing for Mini-pile																																															
3020	Casing for Socketted H-pile	55	28FEB10	23APR10	0	Casing for Socketted H-pile																																															
3030	Steel Member for Socketted H-pile	55	28FEB10	23APR10	0	Steel Member for Socketted H-pile																																															
3040	DI Water Pipe Puddle & Tee	180	29JAN10	27JUL10	90d	DI Water Pipe Puddle & Tee																																															
3050	DI Water Pipeline	180	29JAN10	27JUL10	1005d	DI Water Pipeline																																															
3060	Steel Member for Shelter	60	29JAN10	29MAR10	1125d	Steel Member for Shelter																																															
<b>Section I of Works</b>																																																					
<b>Drilling Works</b>																																																					
10010	Section I of Work	365	29JAN10	28JAN11	0	Section I of Work																																															
10100	Pre-drilling Works (18 nos)	45	10MAR10	23APR10	0	Pre-drilling Works (18 nos)																																															
10110	Preliminary Socketted H-pile	7	24APR10	30APR10	0	Preliminary Socketted H-pile																																															
10120	Load Test for Preliminary Pile	14	01MAY10	14MAY10	0	Load Test for Preliminary Pile																																															
10130	Socketted H-piling (56 nos)	84	15MAY10	06AUG10	0	Socketted H-piling (56 nos)																																															
10140	Proof Drilling (4 nos)	14	07AUG10	20AUG10	0	Proof Drilling (4 nos)																																															
10150	Load Test for Main Pile (1 no)	14	07AUG10	20AUG10	0	Load Test for Main Pile (1 no)																																															
10160	Removal of DN525 & DN900 conc. pipe	45	04JUL10	17AUG10	164d	Removal of DN525 & DN900 conc. pipe																																															
<b>Final Classifier No. FC11B &amp; FC12B</b>																																																					
11010	Excavation for FC12B	21	21AUG10	10SEP10	0	Excavation for FC12B																																															
11020	Pile Head Construction for FC12B	17	11SEP10	27SEP10	4d	Pile Head Construction for FC12B																																															
11025	Base Slab of FC12B	22	18OCT10	18OCT10	7d	Base Slab of FC12B																																															
11030	Structural Wall for FC12B	35	19OCT10	22NOV10	7d	Structural Wall for FC12B																																															
11040	Watertightness Test for FC12B	20	23NOV10	12DEC10	7d	Watertightness Test for FC12B																																															
11050	Concrete Coating for FC12B	10	18DEC10	27DEC10	32d	Concrete Coating for FC12B																																															
11060	Backfilling for FC12B	20	13DEC10	01JAN11	7d	Backfilling for FC12B																																															
12010	Excavation for 11B	21	11SEP10	01OCT10	0	Excavation for 11B																																															
12020	Pile Head Construction for FC11B	17	02OCT10	18OCT10	0	Pile Head Construction for FC11B																																															

Start date	29JAN10
Finish date	27APR13
Data date	29JAN10
Run date	06APR10
Page number	1A
© Primavera Systems, Inc.	

	Early bar
	Progress bar
	Critical bar
	Summary bar
	Start milestone point
	Finish milestone point

**China Harbour Engineering Co. Ltd.**  
**TPSTW Stage 5 Phase 2B**

Date	Revision	Checked	Approved
05FEB10	0	WML	TKC
07APR10	1	AA	TKC

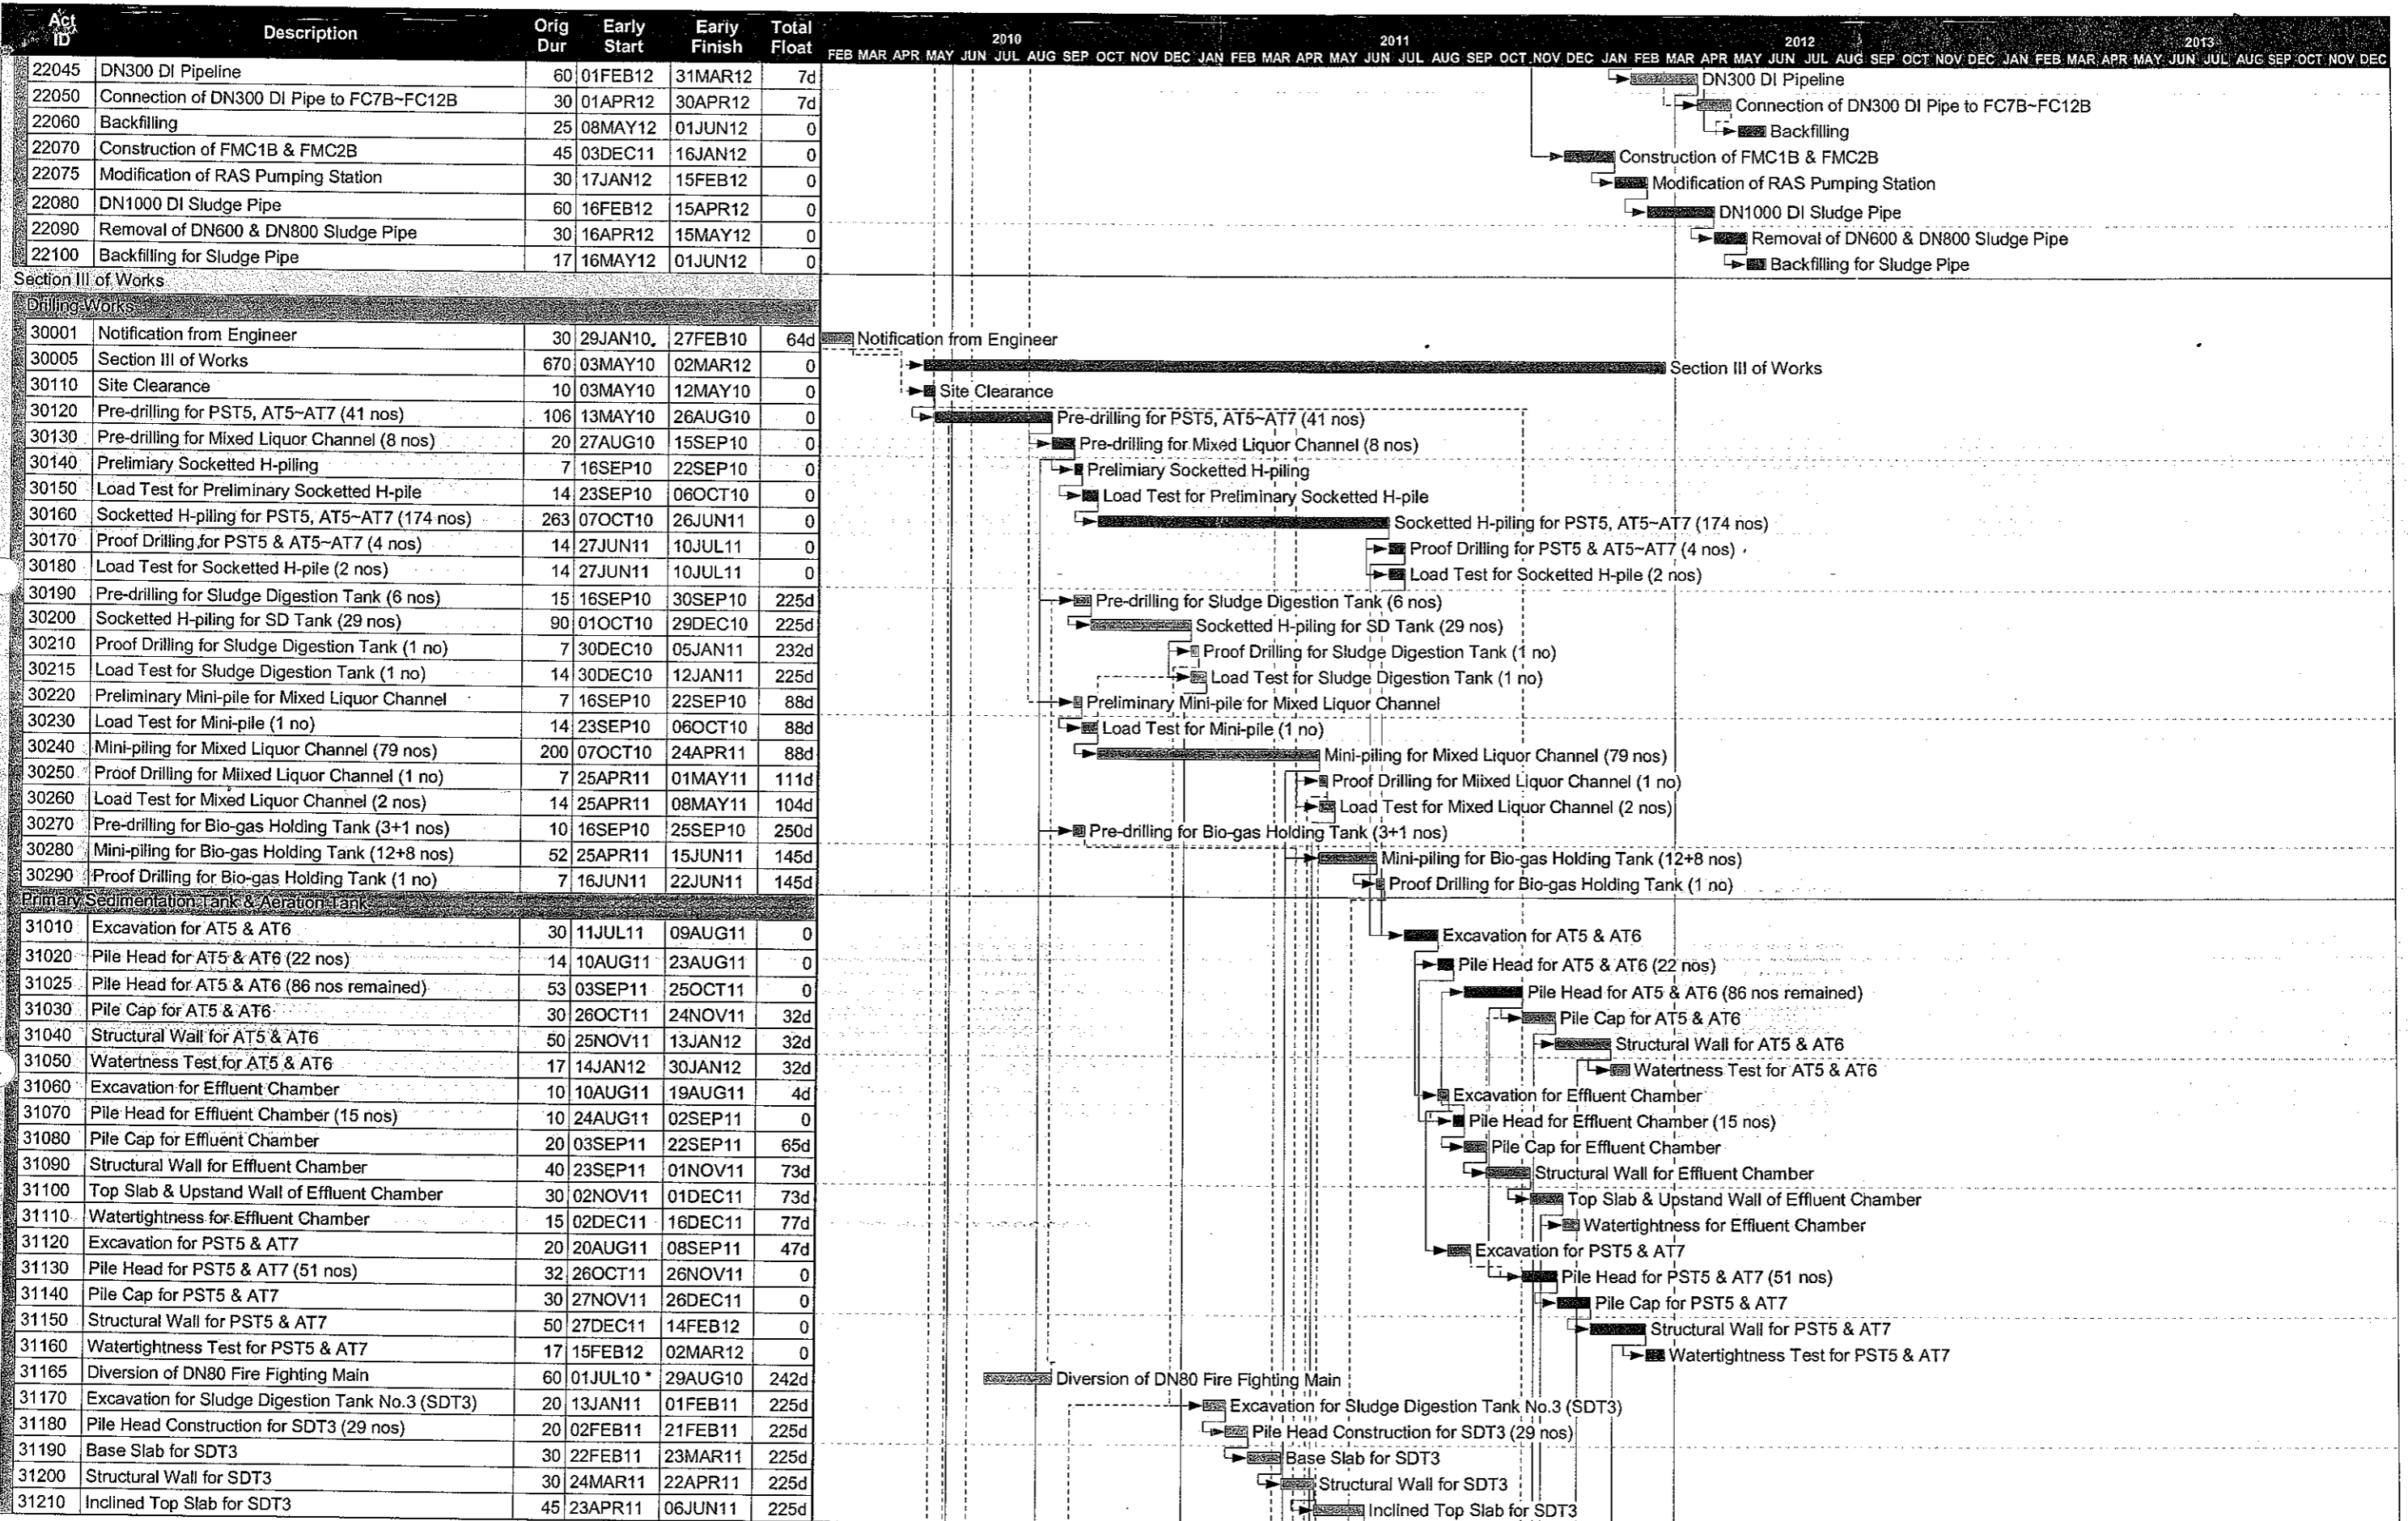

Start date	29JAN10
Finish date	27APR13
Data date	29JAN10
Run date	06APR10
Page number	3A
© Primavera Systems, Inc.	

	Early bar
	Progress bar
	Critical bar
	Summary bar
	Start milestone point
	Finish milestone point

**China Harbour Engineering Co. Ltd.**  
**TPSTW Stage 5 Phase 2B**

Date	Revision	Checked	Approved
05FEB10	0	WML	TKC
07APR10	1	AA	TKC



Act ID	Description	Orig Dur	Early Start	Early Finish	Total Float	2010												2011												2012												2013											
						FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	
43110	Modification of Central Blg Complex	150	01JUN10 *	28OCT10	92d	Modification of Central Blg Complex																																															
43120	Modification of SAS Thickening House	120	15JUN10 *	12OCT10	48d	Modification of SAS Thickening House																																															
43130	Modification of Primary Sludge Thickener	60	13OCT10	11DEC10	48d	Modification of Primary Sludge Thickener																																															
43140	Modification of Filtrate Treatment Plant	120	01JUL10 *	28OCT10	92d	Modification of Filtrate Treatment Plant																																															
43150	Modification of Chlorination House	150	15JUL10 *	11DEC10	48d	Modification of Chlorination House																																															
43160	Floor Opening at Service Tower Building (16 nos)	30	01JUN10 *	30JUN10	92d	Floor Opening at Service Tower Building (16 nos)																																															
43165	S S Louvre at Inlet Works at Stage IV	60	01JUL10	29AUG10	92d	S S Louvre at Inlet Works at Stage IV																																															
43170	Covered Walkway at Sludge Dewatering House	60	30AUG10	28OCT10	92d	Covered Walkway at Sludge Dewatering House																																															
<b>Road &amp; Drainage Works</b>																																																					
42010	Road & Drainage Works in Portion A	120	21JUL10	17NOV10	362d	Road & Drainage Works in Portion A																																															
42020	Road & Drainage Works along MLC	135	16SEP10	28JAN11	0	Road & Drainage Works along MLC																																															
<b>Section V of Works</b>																																																					
<b>Landscaping Works</b>																																																					
50010	Section V of Works	1185	29JAN10	27APR13	0	Section V of Works																																															
50110	Tree Survey	60	29JAN10	29MAR10	20d	Tree Survey																																															
50120	Tree Transplanting & Felling Tree	90	30MAR10	27JUN10	20d	Tree Transplanting & Felling Tree																																															
50130	Establishment Works to Transplanted Tree	365	28JUN10	27JUN11	670d	Establishment Works to Transplanted Tree																																															
50140	Landscaping Softworks	650	28JUN10	07APR12	20d	Landscaping Softworks																																															
50150	Establishment Works to Softworks	650	28JUN11	07APR13	20d	Establishment Works to Softworks																																															
50160	Irrigation System for Green Roof at TPSTW	120	28JUN10	25OCT10	310d	Irrigation System for Green Roof at TPSTW																																															
50170	Green Roof at Sludge Dewatering System	120	26OCT10	22FEB11	310d	Green Roof at Sludge Dewatering System																																															
50180	Green Roof at Transformer House	120	23FEB11	22JUN11	310d	Green Roof at Transformer House																																															
50190	Establishment Works to Green Roof	365	23JUN11	21JUN12	310d	Establishment Works to Green Roof																																															
<b>Others</b>																																																					
51010	Removal of Waste Bio-burner at PSGT Stage I/II	60	05JUL10 *	02SEP10	28d	Removal of Waste Bio-burner at PSGT Stage I/II																																															
51020	Road & Drainage Works	120	26OCT11	22FEB12	430d	Road & Drainage Works																																															
51030	Cable Ducting and Drawpits	350	01APR12	16MAR13	42d	Cable Ducting and Drawpits																																															

Start date	29JAN10		Early bar
Finish date	27APR13		Progress bar
Data date	29JAN10		Critical bar
Run date	06APR10		Summary bar
Page number	5A		Start milestone point
c Primavera Systems, Inc.			Finish milestone point

**China Harbour Engineering Co. Ltd.**  
**TPSTW Stage 5 Phase 2B**

Date	Revision	Checked	Approved
05FEB10	0	WML	TKC
07APR10	1	AA	TKC