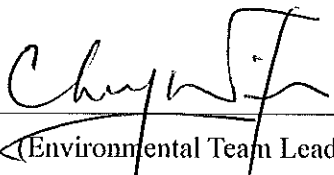


**China Harbour Engineering Company Limited**

Contract No. DC/2009/09  
Construction of Tai Po Sewage Treatment  
Works – Stage V Phase II B

**Monthly Environmental Monitoring  
and Audit Report for  
March 2011**

(Version 1.0)

Certified By   
(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties.

**CINOTECH CONSULTANTS LTD**  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong  
Tel: (852) 2151 2083 Fax: (852) 3107 1388  
Email: [info@cinotech.com.hk](mailto:info@cinotech.com.hk)

## TABLE OF CONTENTS

|                                                                 | Page      |
|-----------------------------------------------------------------|-----------|
| <b>EXECUTIVE SUMMARY .....</b>                                  | <b>1</b>  |
| Introduction .....                                              | 1         |
| Environmental Monitoring and Audit Works .....                  | 1         |
| Environmental Licenses and Permits .....                        | 2         |
| Key Information in the Reporting Month.....                     | 2         |
| Future Key Issues .....                                         | 2         |
| <b>1 INTRODUCTION.....</b>                                      | <b>3</b>  |
| Background.....                                                 | 3         |
| Construction Programme.....                                     | 4         |
| Summary of EM&A Requirements .....                              | 5         |
| <b>2 AIR QUALITY MONITORING .....</b>                           | <b>6</b>  |
| Monitoring Requirements.....                                    | 6         |
| Monitoring Locations .....                                      | 6         |
| Monitoring Equipment .....                                      | 6         |
| Monitoring Parameters, Frequency and Duration .....             | 7         |
| Monitoring Methodology and QA/QC Procedure .....                | 7         |
| Results and Observations .....                                  | 8         |
| <b>3 NOISE MONITORING.....</b>                                  | <b>10</b> |
| Monitoring Requirements.....                                    | 10        |
| Monitoring Locations .....                                      | 10        |
| Monitoring Equipment .....                                      | 10        |
| Monitoring Parameters, Frequency and Duration .....             | 10        |
| Monitoring Methodology and QA/QC Procedures .....               | 11        |
| Results and Observations .....                                  | 12        |
| <b>4 LANDFILL GAS MONITORING.....</b>                           | <b>13</b> |
| Monitoring Requirements.....                                    | 13        |
| Monitoring Parameters and Frequency.....                        | 13        |
| Monitoring Locations .....                                      | 13        |
| Monitoring Equipment .....                                      | 13        |
| Results .....                                                   | 13        |
| <b>5 ENVIRONMENTAL AUDIT.....</b>                               | <b>14</b> |
| Site Audits .....                                               | 14        |
| Review of Environmental Monitoring Procedures.....              | 14        |
| Status of Environmental Licensing and Permitting.....           | 14        |
| Status of Waste Management .....                                | 16        |
| Implementation Status of Environmental Mitigation Measures..... | 16        |
| Summary of Exceedances.....                                     | 17        |
| Implementation Status of Event Action Plans.....                | 17        |
| Summary of Complaint and Prosecution.....                       | 17        |
| <b>6 FUTURE KEY ISSUES .....</b>                                | <b>18</b> |
| Monitoring Schedule for the Next Month .....                    | 18        |
| Construction Program for the Next Month.....                    | 18        |

|                                                |           |
|------------------------------------------------|-----------|
| <b>7 CONCLUSIONS AND RECOMMENDATIONS .....</b> | <b>19</b> |
| Conclusions .....                              | 19        |
| Recommendations .....                          | 19        |

## **LIST OF TABLES**

|           |                                                                            |
|-----------|----------------------------------------------------------------------------|
| Table I   | Summary Table for Events Recorded in the Reporting Month                   |
| Table II  | Summary Table for Key Information in the Reporting Month                   |
| Table 1.1 | Key Project Contacts                                                       |
| Table 2.1 | Locations for Air Quality Monitoring                                       |
| Table 2.2 | Air Quality Monitoring Equipment                                           |
| Table 2.3 | Impact Dust Monitoring Parameters, Frequency and Duration                  |
| Table 2.4 | Summary Table of Air Quality Monitoring Results during the reporting month |
| Table 3.1 | Location of Noise Monitoring Station                                       |
| Table 3.2 | Noise Monitoring Equipment                                                 |
| Table 3.3 | Noise Monitoring Parameters, Frequency and Duration                        |
| Table 3.4 | Summary Table of Noise Monitoring Results during the Reporting Month       |
| Table 4.1 | Landfill Gas Monitoring Equipment                                          |
| Table 5.1 | Summary of Environmental Licensing and Permit Status                       |
| Table 5.2 | Observations and Recommendations of Site Audit                             |

## **LIST OF FIGURE**

|            |                                                        |
|------------|--------------------------------------------------------|
| Figure 1.1 | Site Layout Plan                                       |
| Figure 1.2 | Locations of Air Quality and Noise Monitoring Stations |
| Figure 1.3 | Landfill Gas Monitoring Area                           |

## **LIST OF APPENDICES**

|            |                                                            |
|------------|------------------------------------------------------------|
| Appendix A | Action and Limit Levels                                    |
| Appendix B | Copies of Calibration Certificates                         |
| Appendix C | Environmental Monitoring Schedules                         |
| Appendix D | 1-hour TSP Monitoring Results and Graphical Presentations  |
| Appendix E | 24-hour TSP Monitoring Results and Graphical Presentations |
| Appendix F | Noise Monitoring Results and Graphical Presentations       |
| Appendix G | Records of Landfill Gas Measurement by the Contractor      |
| Appendix H | Summary of Exceedance                                      |
| Appendix I | Site Audit Summary                                         |
| Appendix J | Event Action Plans                                         |
| Appendix K | Updated Environmental Mitigation Implementation Schedule   |
| Appendix L | Waste Generation in the Reporting Month                    |
| Appendix M | Complaint Log                                              |
| Appendix N | Construction Programme                                     |

**EXECUTIVE SUMMARY****Introduction**

1. This is the 9<sup>th</sup> monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for DSD Contract no. DC/2009/09 “Construction of Tai Po Sewage Treatment Works – Stage V Phase IIB”. This report documents the findings of EM&A Works conducted in March 2011.
2. The major site activities undertaken in the reporting month included:
  - Construction of Decanting Chamber, FC11B, FC12B, Chemical & Oil Store;
  - Dismantling works;
  - Diversion works;
  - Drainage and Excavation works;
  - Piling Test for FC11B & FC12B;
  - Mini-piling works;
  - Pre-drilling works;
  - Pre-bored socketted H-pilings;
  - Pipeline works; and
  - Structure works

**Environmental Monitoring and Audit Works**

3. Environmental monitoring and audit works for the Project were performed regularly as stipulated in the Final EM&A Manual and the results were checked and reviewed. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
4. Summary of the events and action taken in the reporting month is tabulated in **Table I**.

**Table I Summary Table for Events Recorded in the Reporting Month**

| Parameter | No. of Exceedance |             | No. of Events<br>Due to this Project | Action Taken |
|-----------|-------------------|-------------|--------------------------------------|--------------|
|           | Action Level      | Limit Level |                                      |              |
| 1-hr TSP  | 0                 | 0           | 0                                    | N/A          |
| 24-hr TSP | 0                 | 0           | 0                                    | N/A          |
| Noise     | 0                 | 0           | 0                                    | N/A          |

5. In the reporting month, excavation works were undertaken within the 250m Consultation Zone of Shuen Wan Landfill. Landfill gas monitoring was performed by the Safety Officer of the Contractor. All the measured results were complied with the Limit Levels.

**Environmental Licenses and Permits**

6. Environmental related licenses/permits granted to the Project include the Environmental Permit (EP) for the Project, the Discharge Licence, Construction Noise Permit and the Waste Disposal (Chemical Waste) Licence.

**Key Information in the Reporting Month**

7. Summary of key information in this reporting month is tabulated in Table II.

**Table II Summary Table for Key Information in the Reporting Month**

| Event                                                                           | Event Details |                                   | Action Taken                                                        | Status     | Remark |
|---------------------------------------------------------------------------------|---------------|-----------------------------------|---------------------------------------------------------------------|------------|--------|
|                                                                                 | Number        | Nature                            |                                                                     |            |        |
| Complaint received                                                              | 0             | ---                               | N/A                                                                 | N/A        | ---    |
| Changes to the assumptions and key construction / operation activities recorded | 0             | ---                               | N/A                                                                 | N/A        | ---    |
| Status of submissions under EP                                                  | 1             | Monthly EM&A Report (February 11) | Submitted to EPD on 16 <sup>th</sup> March 2011 (EP condition 6.6). | No comment | ---    |
| Notifications of any summons & prosecutions                                     | 0             | ---                               | N/A                                                                 | N/A        | ---    |

**Future Key Issues**

8. Major site activities for the coming two months will include:
- Construction of Decanting Chamber, FC11B, FC12B, FMC2, SDT No.3 Shelter;
  - Demolition Existing FC7B & FC10B;
  - Drainage and Excavation works;
  - Landscaping works;
  - Mini-piling works;
  - Roadwork;
  - Pre-bored socketted H-pilings; and
  - Pipeline works
9. The future environmental concerns are air quality, noise impacts, waste management and surface runoff from construction works.

## 1 INTRODUCTION


### Background

- 1.1 Tai Po Sewage Treatment Works (TPSTW) is located within the Tai Po Industrial Estate. It currently comprises four Stages: I, II, IVA and IVB works. The TPSTW - Stage V aims to upgrade the existing STW to provide additional sewage treatment capacity from the present design flow of 88,000 m<sup>3</sup>/day to 130,000 m<sup>3</sup>/day to meet the demands of both the existing and future developments, and to meet the revised discharge license requirements.
- 1.2 The TPSTW Stage V, Phase I and Phase II are Designated Projects under the Environmental Impact Assessment Ordinance (Cap. 449) with the same EIAO Register No. AEIAR – 081/2004. A study of environmental impact assessment (EIA) was undertaken to evaluate various environmental impacts associated with the works within these two Designated Projects. An EIA Report as well as an Environmental Monitoring and Audit (EM&A) Manual were approved by the Environmental Protection Department (EPD) on 28 October 2004.
- 1.3 The Stage V works will be implemented in 2 phases. The design capacities of Phase I and Phase II works are 100,000 m<sup>3</sup>/d and 130,000 m<sup>3</sup>/d respectively. An Environmental Permit (EP) No. EP-265/2007 was issued on 22 March 2007 for the TPSTW Stage V Phase II to the Drainage Services Department (DSD) as the Permit Holder. The project “Tai Po Sewage Treatment Works – Stage V Phase IIB” formed part of the Phase II works, includes additional secondary treatment process units ( 1 primary clarifier; 3 bioreactors and 2 final clarifiers) in TPSTW for its future extended plant design capacity of 120,000 m<sup>3</sup>/day. A master construction programme of the Project is provided in **Appendix N**. A site layout plan is provided in **Figure 1.1**. The construction activities of the Project commenced on 3 July 2010.
- 1.4 Cinotech Consultants Ltd. was commissioned by the Contractor as the Environmental Team (ET) to undertake the EM&A works for the Project. Dr. Priscilla CHOY of Cinotech Consultants Ltd. was appointed as the ET Leader as per the Condition 2.1 of the EP. Ove Arup and Partners Hong Kong Limited. was appointed as the IEC under Condition 2.2 of the EP. This is the 9<sup>th</sup> monthly EM&A report summarizing the EM&A works for the Project in March 2011.

### Project Organizations

- 1.5 Different parties with different levels of involvement in the project organization include:
- Project Proponent / Engineer’s Representative (ER) – Drainage Services Department
  - Environmental Team (ET) – Cinotech Consultants Ltd.
  - Independent Environmental Checker (IEC) – Ove Arup and Partners Hong Kong Limited
  - Contractor – China Harbour Engineering Company Ltd.
- 1.6 The responsibilities of respective parties are detailed in Section 1.10 of the Final EM&A Manual of the Project.

## 1.7 The Project Organization during Construction Phase

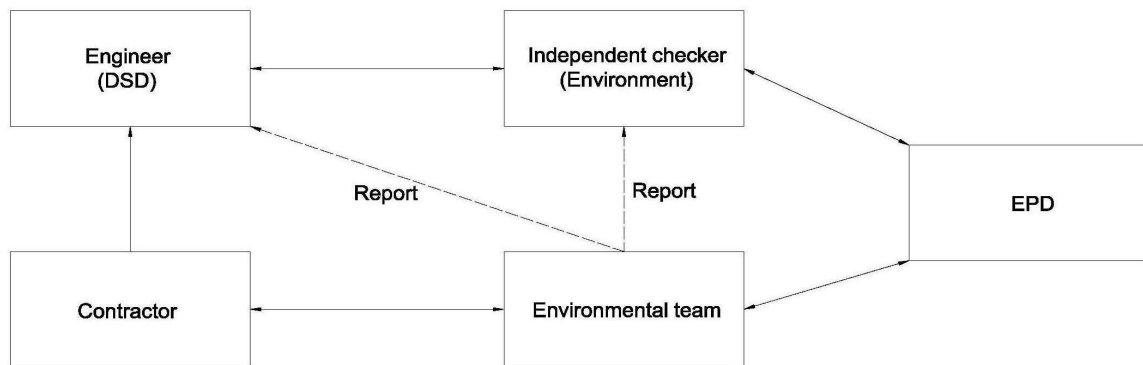

1.8 The key contacts of the Project are shown in **Table 1.1**.

**Table 1.1 Key Project Contacts**

| Party    | Role                              | Name               | Position                                       | Phone No. | Fax No.   |
|----------|-----------------------------------|--------------------|------------------------------------------------|-----------|-----------|
| DSD      | SP Division                       | Mr. LAI cheuk-ho   | Chief Engineer                                 | 2594 7500 | 2827 8700 |
|          |                                   | Mr. IP Shu-kuen    | Senior Engineer                                | 2594 7502 |           |
|          |                                   | Mr. TSANG Lap-kei  | Engineer                                       | 2594 7459 |           |
| Cinotech | Environmental Team                | Dr. Priscilla CHOY | ET Leader                                      | 2151 2089 | 3107 1388 |
|          |                                   | Mr. TY YEUNG       | Project Coordinator and Audit Team Leader      | 2151 2099 |           |
|          |                                   | Mr. Henry LEUNG    | Monitoring Team Leader                         | 2151 2087 |           |
| Arup     | Independent Environmental Checker | Mr. Coleman NG     | Independent Environmental Checker              | 2268 3097 | 2865 6493 |
|          |                                   | Mr. Lawrence KAN   | Assistant to Independent Environmental Checker | 2268 3212 |           |
| CHEC     | Civil Contractor                  | Mr. TK CHEUNG      | Project Manager                                | 9863 2954 | 2603 6899 |
|          |                                   | Mr. Aaron AU       | Site Agent                                     | 6345 0754 |           |
|          |                                   | Mr. Jason TSE      | Environmental Officer                          | 9320 3608 |           |

### Construction Programme

1.9 The site activities undertaken in the reporting month were:

- Construction of Decanting Chamber, FC11B, FC12B, Chemical & Oil Store;
- Dismantling works;
- Diversion works;
- Drainage and Excavation works;
- Piling Test for FC11B & FC12B;
- Mini-piling works;
- Pre-drilling works;
- Pre-bored socketted H-pilings;
- Pipeline works; and
- Structure works

### **Summary of EM&A Requirements**

- 1.10 The EM&A programme requires construction phase air quality and noise monitoring as well as environmental site audits. The EM&A requirements are described in the following sections, including:
- All monitoring parameters;
  - Action and Limit levels for all environmental parameters;
  - Event / Action Plans;
  - Environmental mitigation measures, as recommended in the project EIA study final report; and
  - Environmental requirements in contract documents.
- 1.11 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 5 of this report.
- 1.12 This report presents the monitoring results, observations, locations, equipment, period, methodology and QA/QC procedures of the required monitoring parameters, namely air quality and noise as well as audit works for the Project in the reporting month.



## 2 AIR QUALITY MONITORING

### Monitoring Requirements

- 2.1 Monitoring of 1-hour and 24-hour Total Suspended Particulates (TSP) was conducted to monitor the air quality during construction phase. **Appendix A** shows the established Action/Limit Levels for the environmental monitoring works.
- 2.2 In accordance with Section 2.30 of the EM&A Manual, a baseline checking of ambient TSP levels shall be carried out every six months at each monitoring station, when no dusty works activities are in operation. The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.
- 2.3 The baseline checking of ambient TSP levels is still in progress for consensual decision.

### Monitoring Locations

- 2.4 Impact air quality monitoring was conducted at the 3 monitoring stations, as shown in **Figure 1.2**. **Table 2.1** describes the locations of the air quality monitoring stations.

**Table 2.1 Locations for Air Quality Monitoring**

| Monitoring Stations | Description               | Location of Measurement                                         |
|---------------------|---------------------------|-----------------------------------------------------------------|
| CAM1                | Government Staff Quarters | Rooftop                                                         |
| CAM2                | Hung Hing Printing Centre | On the site boundary just next to the Hung Hing Printing Centre |
| CAM3                | Talcon Industrial Ltd.    | On the site boundary just next to Talcon Industrial Ltd.        |

### Monitoring Equipment

- 2.5 **Table 2.2** summarizes the equipment used for the air quality monitoring.

**Table 2.2 Air Quality Monitoring Equipment**

| Equipment  | Model and Make                                                         | Qty. |
|------------|------------------------------------------------------------------------|------|
| HVS        | Graseby GMW 2310 HVS, Model GS-2310105-1,<br>Serial no. 10239 and 0810 | 2    |
|            | Tisch Environmental, Inc.; Model no. TE-5170,<br>Serial no. 1704       | 1    |
| Calibrator | Thermo Andersen.; Model no. G25A<br>Serial no. 1536                    | 1    |

## Monitoring Parameters, Frequency and Duration

2.6 **Table 2.3** summarizes the monitoring parameters and frequencies of impact dust monitoring for the whole construction period.

**Table 2.3 Impact Dust Monitoring Parameters, Frequency and Duration**

| Monitoring Stations | Parameter   | Duration | Period                | Frequency       |
|---------------------|-------------|----------|-----------------------|-----------------|
| CAM1, CAM2 and CAM3 | 1-hour TSP  | 1 hour   | During daytime period | 3 times / 6-day |
|                     | 24-hour TSP | 24 hours | 24 hours              | Once / 6-day    |

## Monitoring Methodology and QA/QC Procedure

### *Instrumentation*

2.7 High Volume Samplers (HVS) connected with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

### *HVS Installation*

2.8 The following guidelines were adopted during the installation of HVS:

- Sufficient support was provided to secure the samplers against gusty wind.
- No two samplers were placed less than 2 meters apart.
- The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
- A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
- A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
- No furnaces or incineration flues were nearby.
- Airflow around the sampler was unrestricted.
- The samplers were more than 20 meters from the drip line.
- Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.

### *Filters Preparation*

2.9 Fiberglass filters were used which have a collection efficiency of larger than 99% for particles of 0.3  $\mu\text{m}$  diameter. A HOKLAS accredited laboratory, Wellab Ltd., was responsible for the preparation of pre-weighed filter papers for Cinotech's monitoring team.

2.10 All filters, which were prepared by Wellab Ltd., were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than  $\pm 3$  °C; the relative humidity (RH) was

< 50% and not variable by more than  $\pm 5\%$ . A convenient working RH was 40%.

2.11 Wellab Ltd. has a comprehensive quality assurance and quality control programmes.

### *Operating/Analytical Procedures*

2.12 Operating/analytical procedures for the TSP monitoring were highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 and 1.4 m<sup>3</sup>/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the air quality monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts to avoid air leakage at the edges.
- The shelter lid was closed and secured with the aluminum strip.
- The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- The flow rate of the HVS sampler would be verified to be constant and recorded on the data sheet after sampling.
- After sampling, the filter was removed and sent to the Wellab Ltd. for weighing. The elapsed time was also recorded.
- Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment should be between 25°C and 30°C and not vary by more than  $\pm 3^\circ\text{C}$ ; the relative humidity (RH) should be < 50% and not vary by more than  $\pm 5\%$ . A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

### *Maintenance/Calibration*

2.13 The following maintenance/calibration was required for the HVS:

- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
- Calibration of the HVS (five point calibration) using Calibration Kit was carried out every two months. Copies of calibration certificates are attached in **Appendix B**.
- The HVS calibration orifice will be calibrated annually.

### **Results and Observations**

2.14 In the reporting month, 1-hr TSP monitoring was carried out as schedule at each designated monitoring station on 13 occasions. 24-hr TSP monitoring was carried out

as scheduled at each designated monitoring station on 5 occasions. The monitoring schedule was updated and is shown in **Appendix C**. The weather during the monitoring sessions was mainly sunny, fine and cloudy.

- 2.15 All measured 1-hr and 24-hr TSP levels were below the Action/Limit Levels. No exceedance was recorded in the reporting month.
- 2.16 The monitoring data and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices D** and **E**, respectively.

**Table 2.4 Summary Table of Air Quality Monitoring Results during the reporting month**

| Parameter           | Minimum<br>$\mu\text{g}/\text{m}^3$ | Maximum<br>$\mu\text{g}/\text{m}^3$ | Average<br>$\mu\text{g}/\text{m}^3$ | Action Level,<br>$\mu\text{g}/\text{m}^3$ | Limit Level,<br>$\mu\text{g}/\text{m}^3$ |
|---------------------|-------------------------------------|-------------------------------------|-------------------------------------|-------------------------------------------|------------------------------------------|
| 1-hr TSP<br>(CAM1)  | 37                                  | 241                                 | 150                                 | 315                                       | 500                                      |
| 24-hr TSP<br>(CAM1) | 42                                  | 118                                 | 86                                  | 171                                       | 260                                      |
| <hr/>               |                                     |                                     |                                     |                                           |                                          |
| 1-hr TSP<br>(CAM2)  | 89                                  | 253                                 | 172                                 | 336                                       | 500                                      |
| 24-hr TSP<br>(CAM2) | 75                                  | 124                                 | 97                                  | 177                                       | 260                                      |
| <hr/>               |                                     |                                     |                                     |                                           |                                          |
| 1-hr TSP<br>(CAM3)  | 108                                 | 264                                 | 182                                 | 344                                       | 500                                      |
| 24-hr TSP<br>(CAM3) | 84                                  | 137                                 | 105                                 | 192                                       | 260                                      |

- 2.17 According to our field observations, the major dust source identified at the designated air quality monitoring stations are as follows:

| Station                          | Major Pollution Source           |
|----------------------------------|----------------------------------|
| CAM1 – Government Staff Quarters | Road Traffic Dust                |
| CAM2 – Hung Hing Printing Centre | Road Traffic Dust and Excavation |
| CAM3 – Talcon Industrial Ltd.    | Road Traffic Dust and Excavation |

### 3 NOISE MONITORING

#### Monitoring Requirements

- 3.1 Noise monitoring was conducted in accordance with the EM&A Manual. **Appendix A** shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.

#### Monitoring Locations

- 3.3 Noise monitoring was conducted at one designated monitoring station as presented in **Table 3.1**. **Figure 1.2** shows the locations of the monitoring station.

**Table 3.1 Location of Noise Monitoring Station**

| Monitoring Station | Description               | Location of Measurement          |
|--------------------|---------------------------|----------------------------------|
| NM1                | Government Staff Quarters | The corridor at the first floor. |

#### Monitoring Equipment

- 3.4 **Table 3.2** summarizes the noise monitoring equipment model being used.

**Table 3.2 Noise Monitoring Equipment**

| Equipment                     | Model and Make                                        | Quantity |
|-------------------------------|-------------------------------------------------------|----------|
| Integrating Sound Level Meter | SVAN 955 (Serial No. 12563)                           | 3        |
|                               | SVAN 955 (Serial No. 14303)                           |          |
|                               | 2250 Light (Serial No. 2681378)                       |          |
| Calibrator                    | SV30A (Serial No. 10965)                              | 1        |
| Wind Speed Anemometer         | Vane Anemometer, Model 451104<br>(Serial no. 9020746) | 1        |

#### Monitoring Parameters, Frequency and Duration

- 3.5 **Table 3.3** summarizes the monitoring parameters, frequency and total duration of monitoring.

**Table 3.3 Noise Monitoring Parameters, Frequency and Duration**

| Station | Parameter                                                                                      | Period                            | Frequency   |
|---------|------------------------------------------------------------------------------------------------|-----------------------------------|-------------|
| NM1     | $L_{eq}$ (30 min.)<br>( $L_{10}$ and $L_{90}$ were also recorded as supplementary information) | 0700-1900 hrs. on normal weekdays | Once a week |

- 3.6 If construction works are extended to include works during the hours of 1900 - 0700, additional weekly impact monitoring would be carried out during evening and night-time works. Applicable permits under NCO have been obtained by the Contractor. The details of the Construction Noise Permit can be referred to **Table 5.1**.

## Monitoring Methodology and QA/QC Procedures

### *Field Monitoring*

3.7 The monitoring procedures are as follows:

- The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- The battery condition was checked to ensure good functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
  - frequency weighting : A
  - time weighting : Fast
  - measurement time : 30 minutes
- Prior to and after noise measurement, the meter was calibrated using the calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement is more than 1.0 dB, the measurement was considered invalid and repeat of noise measurement was required after re-calibration or repair of the equipment.
- The wind speed at the monitoring station was checked with the portable wind meter. Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.
- Noise measurement was paused during periods of high intrusive noise if possible and observation was recorded when intrusive noise was not avoided.
- At the end of the monitoring period, the  $L_{eq}$ ,  $L_{10}$  and  $L_{90}$  were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.

### *Maintenance and Calibration*

3.8 Maintenance and Calibration procedures were as follows:

- The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- The sound level meter and calibrator were checked and calibrated at yearly intervals. Copies of calibration certificates are attached in **Appendix B**.

### Results and Observations

- 3.9 In the reporting month, noise monitoring during non-restricted hours was conducted as scheduled at the designated location on 4 occasions. As advised by the Contractor, no construction activities will be undertaken during restricted hours as such noise monitoring during restricted hours was omitted. The noise monitoring schedule is provided in **Appendix C**.
- 3.10 The details of the monitoring results and graphical presentations are shown in **Appendix F**. The weather during the monitoring sessions was mainly sunny and fine.
- 3.11 No Action/Limit Level exceedance for construction noise monitoring was recorded in the reporting month.

**Table 3.4 Summary Table of Noise Monitoring Results during the Reporting Month**

| Parameter | Minimum Leq(30min) dB(A) | Maximum Leq(30min) dB(A) | Average Leq(30min) dB (A) | Action Level                              | Limit Level |
|-----------|--------------------------|--------------------------|---------------------------|-------------------------------------------|-------------|
| NM1       | 62.1                     | 64.9                     | 63.6                      | When one documented complaint is received | 75dB(A)     |

- 3.12 According to our field observations, the major noise source identified at the designated air quality monitoring stations are as follows:

| Station                         | Major Noise Source                        |
|---------------------------------|-------------------------------------------|
| NM1 – Government Staff Quarters | Road Traffic<br>Construction of Main Site |

## 4 LANDFILL GAS MONITORING

### Monitoring Requirements

- 4.1 In accordance with Section 6 of the EM&A Manual, monitoring of landfill gas is required for construction works within the 250m Consultation Zone of Shuen Wan Landfill (the Consultation Zone). This Section reports the results of landfill gas measurements performed by the Safety Officer of the Contractor. **Appendix A** shows the Limit Levels for the monitoring works.

### Monitoring Parameters and Frequency

- 4.2 The parameters for Landfill gas monitoring include Percentage of Combustible Gas (Methane), Carbon dioxide and Oxygen.
- 4.3 The Landfill gas monitoring is carried out before the entry of concern zone by the Contractor in the morning and afternoon.

### Monitoring Locations

- 4.4 Monitoring of oxygen, methane and carbon dioxide was performed for excavations at 1m depth or more within the Consultation Zone. In this reporting month, the area required to be monitored for landfill gas are shown below and **Figure 1.3** shows the landfill gas monitoring locations.
- FC11B and FC12B
  - Dewatering House

Remark:

Excavation works of 1m depth or more at Pipe 300, 600 and 900 Excavation Trench has been completed.

### Monitoring Equipment

- 4.5 **Table 4.1** summarizes the equipment employed by the Contractor for the landfill gas monitoring.

**Table 4.1 Landfill Gas Monitoring Equipment**

| Equipment                                 | Model and Make                                                          | Quantity |
|-------------------------------------------|-------------------------------------------------------------------------|----------|
| Intrinsically safe, portable gas detector | Crowcon Custodian CDL Portable Gas Detector<br>(Serial No. 24800 37076) | 1        |

### Results

- 4.6 In the reporting month, landfill gas monitoring was carried out by the Contractor at the aforesaid locations on total 188 occasions. No Action/Limit Level exceedance for Landfill gas monitoring was recorded in the reporting month. The monitoring results are provided in **Appendix G**. Copies of calibration certificates are attached in **Appendix B**.



## 5 ENVIRONMENTAL AUDIT

### Site Audits

- 5.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Project site. The summaries of site audits are attached in **Appendix H**.
- 5.2 Site audits were conducted on 3<sup>rd</sup>, 11<sup>th</sup>, 17<sup>th</sup>, 24<sup>th</sup> and 31<sup>st</sup> March 2011 by ET. A joint site audit with the representative with IEC, ER, the Contractor and the ET was carried out on 11<sup>th</sup> March 2011. No site inspection was conducted by EPD during the reporting month. The details of observations during site audit can refer to **Table 5.2**.

### Review of Environmental Monitoring Procedures

- 5.3 The monitoring works conducted by the monitoring team were inspected regularly. The following observations have been recorded for the monitoring works:

#### *Air Quality Monitoring*

- The monitoring team recorded all observations around the monitoring stations within and outside the construction site.
- The monitoring team recorded the temperature and weather conditions on the monitoring days.

#### *Noise Monitoring*

- The monitoring team recorded all observations around the monitoring stations, which might affect the monitoring result.
- Major noise sources were identified and recorded. Other intrusive noise attributing to the result was trimmed off by pausing the monitoring temporarily.

#### *Landfill Gas Monitoring*

- The Contractor has checked the condition of the equipment before monitoring to ensure the reliability.

### Status of Environmental Licensing and Permitting

- 5.4 All permits/licenses obtained for the Project are summarized in **Table 5.1**.

**Table 5.1 Summary of Environmental Licensing and Permit Status**

| Permit / License No.                   | Valid Period |                | Details                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Status |
|----------------------------------------|--------------|----------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|
|                                        | From         | To             |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |        |
| <b>Environmental Permit (EP)</b>       |              |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |        |
| EP-265/2007                            | 22/3/2007    | N/A            | <p><u>Expansion and upgrading of existing Tai Po Sewage Treatment Works from 100,000 m<sup>3</sup>/day to 130,000 m<sup>3</sup>/day:</u></p> <p>(a) additional secondary treatment process units(1 primary clarified; 3 bioreactors and 2 final clarifiers);</p> <p>(b) reconstruction of 4 existing final clarified;</p> <p>(c) provision of ultraviolet disinfection facilities;</p> <p>(d) additional sludge treatment facilities; and</p> <p>(e) ancillary works to existing treatment facilities.</p> | Valid  |
| <b>Construction Noise Permit (CNP)</b> |              |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |        |
| GW-RN0387-10                           | 17/11/10     | 16/05/11       | <p>Use of powered mechanical equipment for carrying out construction work at 7 Dai Kwai Street, Tai Po Industrial Estate, Tai Po, N.T. during 0000 – 2400 hours on general holidays (including Sundays), 0000 – 0700 hours and 1900 – 2400 hours on any day not being a general holiday.</p>                                                                                                                                                                                                               | Vaild  |
| GW-RN0036-11                           | 01/02/11     | 31/07/11       |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Vaild  |
| <b>Discharge Licence</b>               |              |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |        |
| WT00007782-2010                        | 25/10/10     | 31/10/15       | <p>Discharge of industrial trade effluent:</p> <p><i>Water Control Zone:</i> Tolo Harbour and Channel</p> <p><i>Discharge Points:</i> Communal drain for the carriage of surface drainage water</p>                                                                                                                                                                                                                                                                                                        | Valid  |
| <b>Waste Disposal (Chemical Waste)</b> |              |                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |        |
| WPN :<br>5213-727-C2397-16             | 09/07/10     | End of Project | Disposal of Chemical Waste including spent oil, lubricating oil, diesel oil and methanol, surplus paint, thinner                                                                                                                                                                                                                                                                                                                                                                                           | Valid  |

### Status of Waste Management

5.5 The Construction and Demolition (C&D) materials generated in the reporting month were mainly inert C&D waste and C&D waste. The quantities of waste generated in this reporting month are summarized in **Appendix L**. No chemical waste was generated in the reporting month.

### Implementation Status of Environmental Mitigation Measures

5.6 According to the EIA Study Report, Environmental Permit and the EM&A Manual of the Project, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix K**.

5.7 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 5.2**.

**Table 5.2 Observations and Recommendations of Site Audit**

| Parameters           | Date          | Observations and Recommendations                                                                                                                                            | Follow-up                                                                |
|----------------------|---------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------|
| <i>Water Quality</i> | 3-March-2011  | <u>Reminder:</u><br>- The stagnant water should be cleared regularly at A-Tank. The Contractor was reminded to reinforce the drainage system.                               | The situation was observed rectified in audit session 110311.            |
|                      | 3-March-2011  | <u>Reminder:</u><br>- The Contractor was reminded to ensure the drainage system can be functioned properly, to avoid silty water directing to water channel.                | The situation was observed rectified in audit session 110317.            |
|                      | 11-March-2011 | <u>Observation:</u><br>- The drainage system was observed functioning improperly at FC11B&12B. The Contractor was reminded to rectify the mitigation.                       | The situation was observed rectified in audit session 110317.            |
|                      | 11-March-2011 | <u>Reminder:</u><br>- The Contractor was reminded to reinforce the bunding area, to avoid the wastewater directing to the road at outside site office.                      | The situation was observed rectified in audit session 110317.            |
|                      | 17-March-2011 | <u>Observation:</u><br>- The wheel washing bay was observed full of deposited mud at FC11B&12B. The Contractor was reminded to clear the deposited mud as soon as possible. | The situation was observed rectified in audit session 110324.            |
|                      | 31-March-2011 | <u>Reminder:</u><br>- The ponding water should be cleared regularly at A-Tank.                                                                                              | The situation required follow-up action during the coming audit session. |
|                      | 31-March-2011 | <u>Reminder:</u><br>- The stagnant water within the sedimentation tank should be cleared at A-Tank.                                                                         | The situation required follow-up action during the coming audit session. |

|                                            |               |                                                                                                                    |                                                               |
|--------------------------------------------|---------------|--------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------|
| <i>Waste /<br/>Chemical<br/>Management</i> | 17-March-2011 | <u>Reminder:</u><br>- The general refuse within the rubbish bin should be cleared regularly at FC11B&12B.          | The situation was observed rectified in audit session 110324. |
|                                            | 24-March-2011 | <u>Reminder:</u><br>- The general refuse should be cleared regularly, to avoid accumulation of waste at FC11B&12B. | The situation was observed rectified in audit session 110331. |
|                                            | 24-March-2011 | <u>Reminder:</u><br>- The deposited mud at haul road should be cleared at FC11B&12B.                               | The situation was observed rectified in audit session 110331. |

### Summary of Exceedances

5.8 No exceedance of monitoring results was recorded in the reporting month. Summary of exceedance is provided in **Appendix H**.

### Implementation Status of Event Action Plans

5.9 The Event Action Plans for air quality, construction noise and landfill gas monitoring are presented in **Appendix J**. No exceedance was recorded and thus no action was required to be implemented.

### Summary of Complaint and Prosecution

5.10 No environmental related complaint, prosecution or notification of summons was received in the reporting month.

5.11 There was no environmental complaint, prosecution or notification of summons received since the Project commencement. The Complaint Log is attached in **Appendix M**.

## 6 FUTURE KEY ISSUES

6.1 Key issues to be considered in the coming month include:

- Effluent discharge generated from surface runoff;
- Dust generated from excavation works, backfilling works and stockpile of dusty materials;
- Maintenance of de-silting facilities and drainage system, such as U-channels;
- Accumulation of stagnant water in the site areas; and
- Accumulation of C&D waste and general waste on site.

### **Monitoring Schedule for the Next Month**

6.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix C**.

### **Construction Program for the Next Month**

6.3 A tentative construction programme is provided in **Appendix N**. The major construction activities in the coming month will include:

- Confined Space Works
- Structure works;
- Dismantling works;
- Drainage and Excavation works;
- Landscaping works;
- Mini-piling works;
- Pre-drilling works;
- Pre-bored socketted H-pilings; and
- Pipeline works

## 7 CONCLUSIONS AND RECOMMENDATIONS

### Conclusions

- 7.1 Environmental monitoring and audit works were conducted in the reporting month. Site inspections were conducted on a weekly basis. The results were reviewed and checked.
- 7.2 No exceedance of monitoring results was recorded in the reporting month.
- 7.3 There was no environmental complaint, prosecution or notification of summons received.

### Recommendations

- 7.4 According to the environmental audit performed in the reporting month, the following recommendations were made:

#### *Water Impact*

- To provide sediment tank for settling runoff prior to disposal.
- To ensure proper use and maintenance of the de-silting facilities.
- To avoid accumulation of stagnant water on site.
- To maintain sand bags placed along the u-channel at good condition and replace the broken bags.
- To avoid blockage of gully inlets and ensure proper protection of the gully from ingress of sandy water.

#### *Dust Impact*

- To remove fugitive dusty material on the haul road periodically.
- To spray with water on the surface of concrete breaking and dry dust haul road.
- Excavated dusty materials or stockpile of dusty materials should be covered by impervious sheeting, or sprayed with water so as to maintain entire surface wet.

#### *Noise Impact*

- To space out noisy equipment and position as far away as possible from sensitive receivers.

#### *Waste / Chemical Management*

- To provide proper rubbish bins / skips for waste collection.
- To provide proper storage area for oil container on site.
- To avoid and check for any accumulation of waste materials or rubbish on site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the equipment.
- Provide drip tray with adequate capacity and maintain well for equipment and chemical waste.


---

---

## FIGURES

---

---

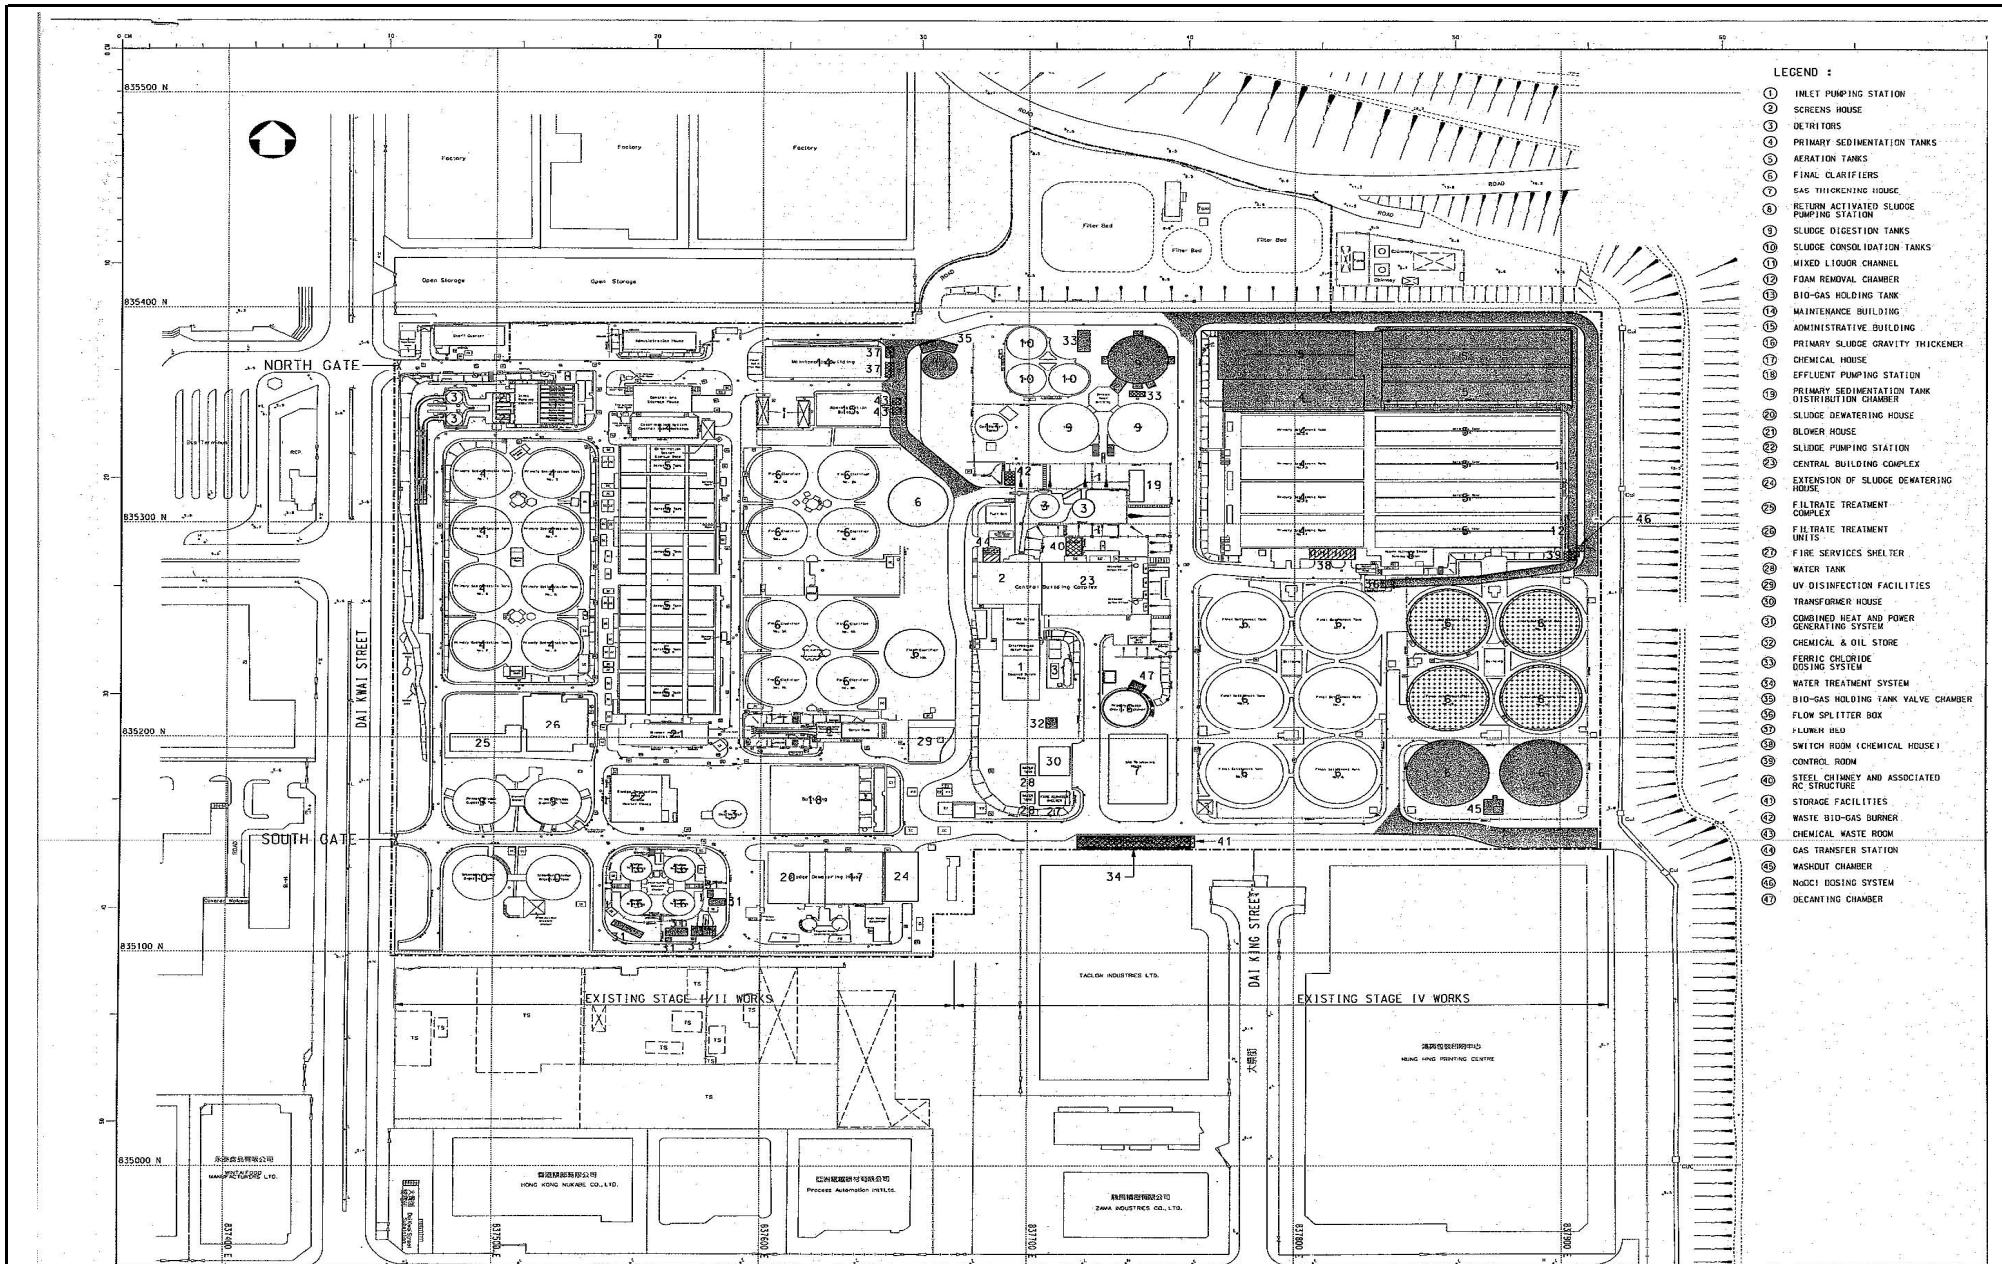


- LEGEND :
- ① INLET PUMPING STATION
  - ② SCREENS HOUSE
  - ③ DETRITORS
  - ④ PRIMARY SEDIMENTATION TANKS
  - ⑤ AERATION TANKS
  - ⑥ FINAL CLARIFIERS
  - ⑦ GAS THICKENING HOUSE
  - ⑧ REDUCED ACTIVATED SLUDGE PUMPING STATION
  - ⑨ SLUDGE DIGESTION TANKS
  - ⑩ SLUDGE CONSOLIDATION TANKS
  - ⑪ MIXED LIQUOR CHANNEL
  - ⑫ FOG REMOVAL CHAMBER
  - ⑬ BIO-GAS HOLDING TANK
  - ⑭ MAINTENANCE BUILDING
  - ⑮ ADMINISTRATIVE BUILDING
  - ⑯ PRIMARY SLUDGE GRAVITY THICKENER
  - ⑰ CHEMICAL HOUSE
  - ⑱ EFFLUENT PUMPING STATION
  - ⑲ PRIMARY SEDIMENTATION TANK DISTRIBUTION CHAMBER
  - ⑳ SLUDGE DEWATERING HOUSE
  - ㉑ BLOWER HOUSE
  - ㉒ SLUDGE PUMPING STATION
  - ㉓ CENTRAL BUILDING COMPLEX
  - ㉔ EXTENSION OF SLUDGE DEWATERING HOUSE
  - ㉕ FILTRATE TREATMENT COMPLEX
  - ㉖ FILTRATE TREATMENT UNITS
  - ㉗ FIRE SERVICES SHELTER
  - ㉘ WATER TANK
  - ㉙ UV DISINFECTION FACILITIES
  - ㉚ TRANSFORMER HOUSE
  - ㉛ COMBINED HEAT AND POWER GENERATING SYSTEM
  - ㉜ CHEMICAL & OIL STORE
  - ㉝ FERRIC CHLORIDE DOSING SYSTEM
  - ㉞ WATER TREATMENT SYSTEM
  - ㉟ BIO-GAS HOLDING TANK VALVE CHAMBER
  - ㊱ FLOW SPLITTER BOX
  - ㊲ FLUMM BELL
  - ㊳ SWITCH ROOM (CHEMICAL HOUSE)
  - ㊴ CONTROL ROOM
  - ㊵ STEEL CHIMNEY AND ASSOCIATED RC STRUCTURE
  - ㊶ STORAGE FACILITIES
  - ㊷ WASTE BIO-GAS BURNER
  - ㊸ CHEMICAL WASTE ROOM
  - ㊹ GAS TRANSFER STATION
  - ㊺ WASHOUT CHAMBER
  - ㊻ NODDI DOSING SYSTEM
  - ㊼ DECATING CHAMBER

TAI PO SEWAGE TREATMENT WORKS, STAGE V, PHASE IIB

PROJECT SITE LAYOUT PLAN (TPSTW)

|       |        |             |        |                 |
|-------|--------|-------------|--------|-----------------|
| Scale | N.T.S  | Project No. | MA0010 | <b>CINOTECH</b> |
| Date  | Jul-10 | Figure      | 1.1    |                 |



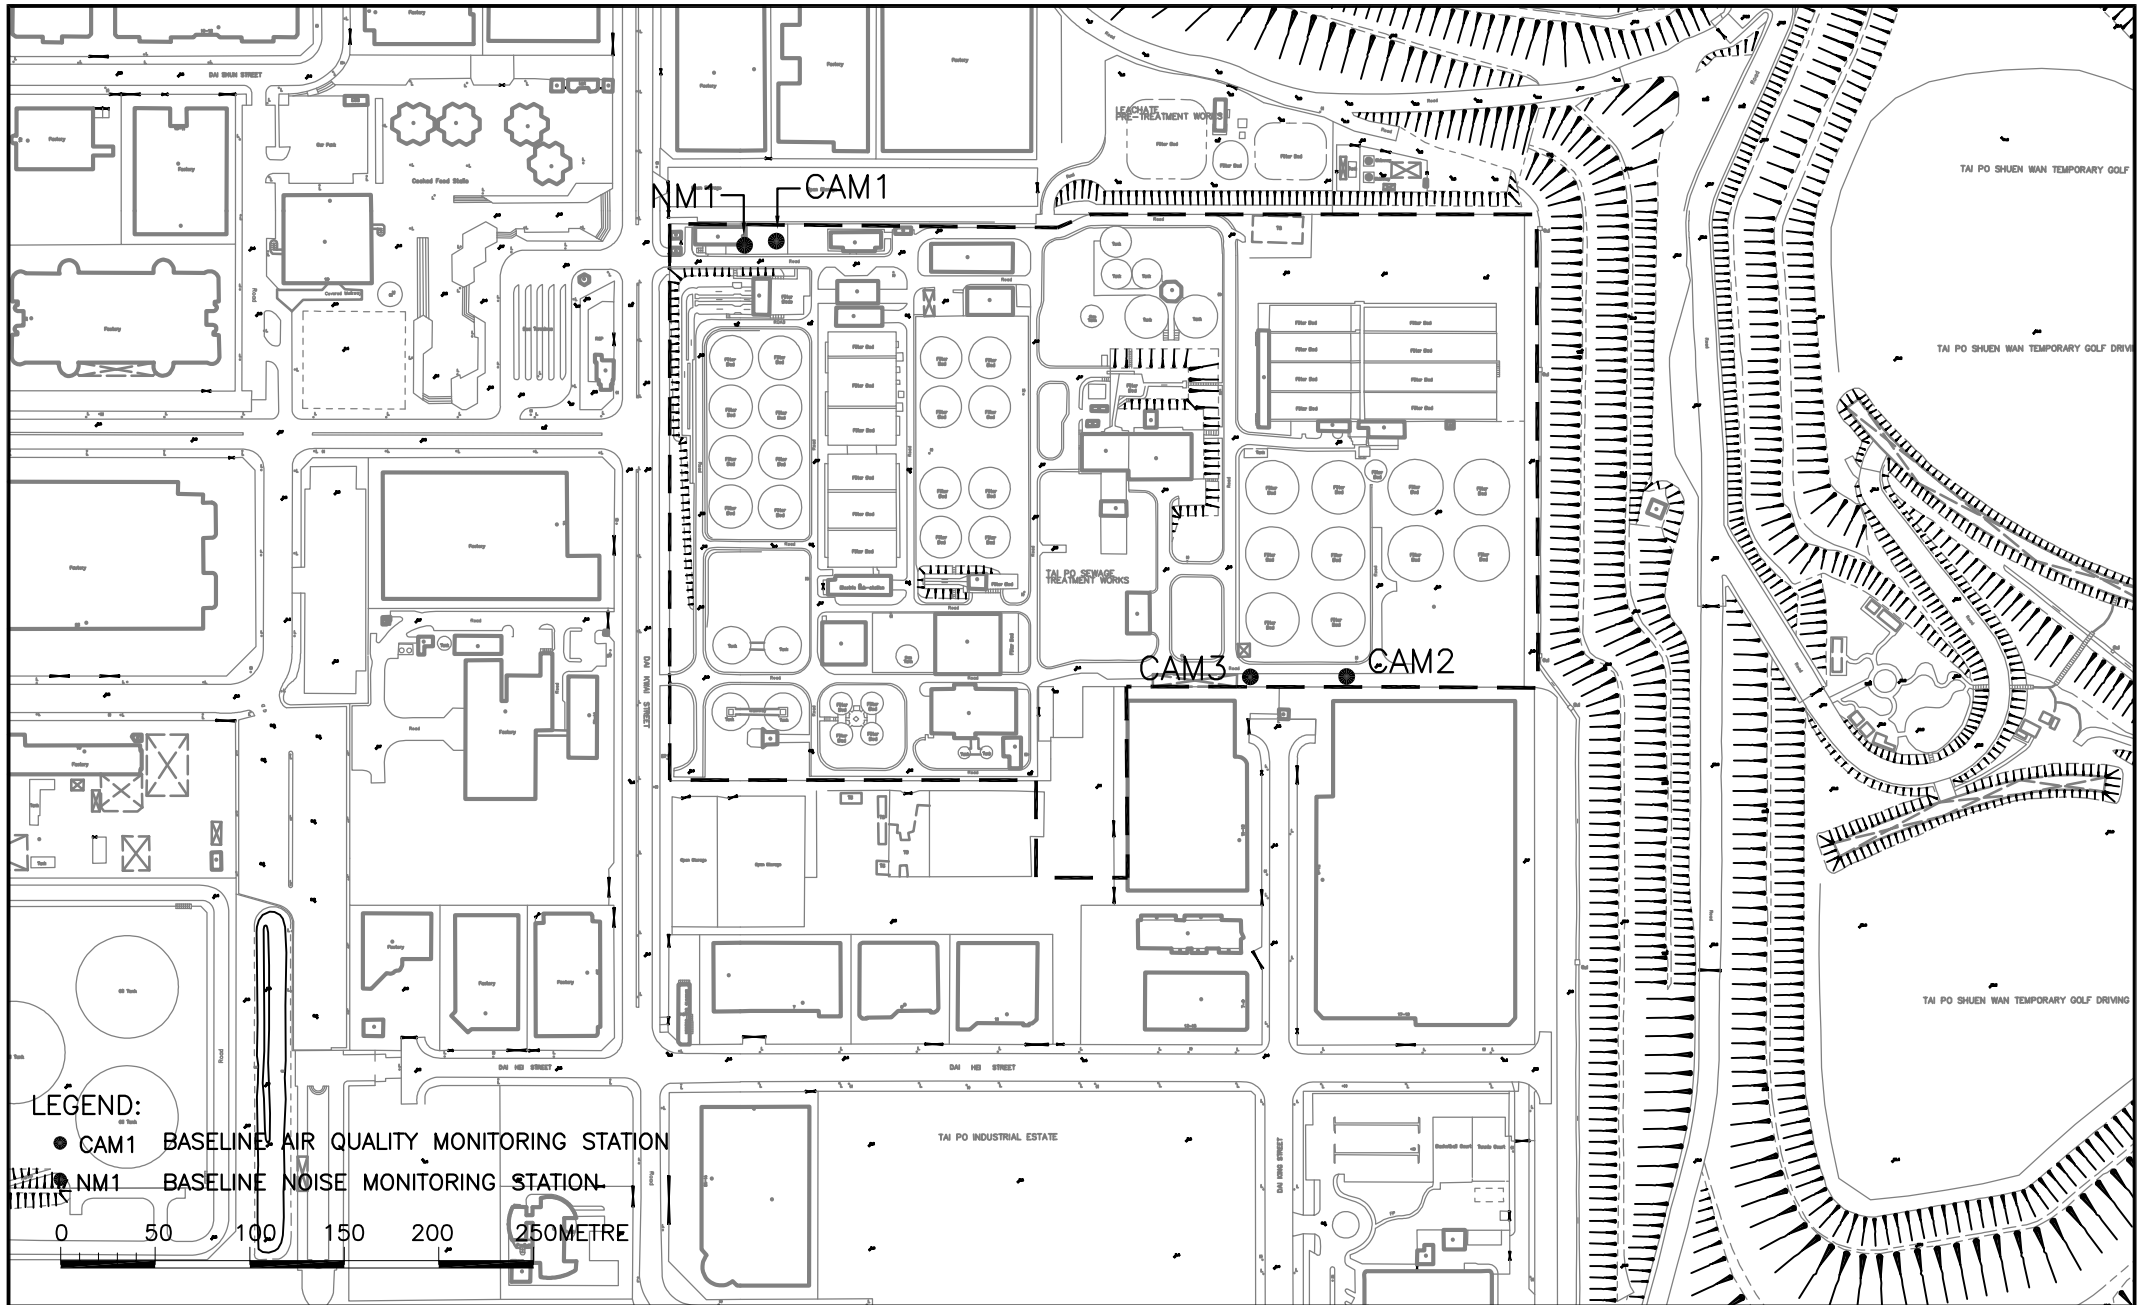

**LEGEND:**

- CAM1 BASELINE AIR QUALITY MONITORING STATION
- NM1 BASELINE NOISE MONITORING STATION


0 50 100 150 200 250METRE



Tai Po Sewage Treatment Work, Stage V, Phase IIB

**LOCATIONS OF AIR QUALITY AND NOISE MONITORING STATIONS**

|         |           |             |      |     |
|---------|-----------|-------------|------|-----|
| SCALE   | A4 1:4000 | DATE        | 2010 |     |
| CHECK   | IT        | DRAWN       | SL   |     |
| JOB No. | MA0010    | DRAWING No. | 1.2  | REV |
|         |           |             |      | —   |

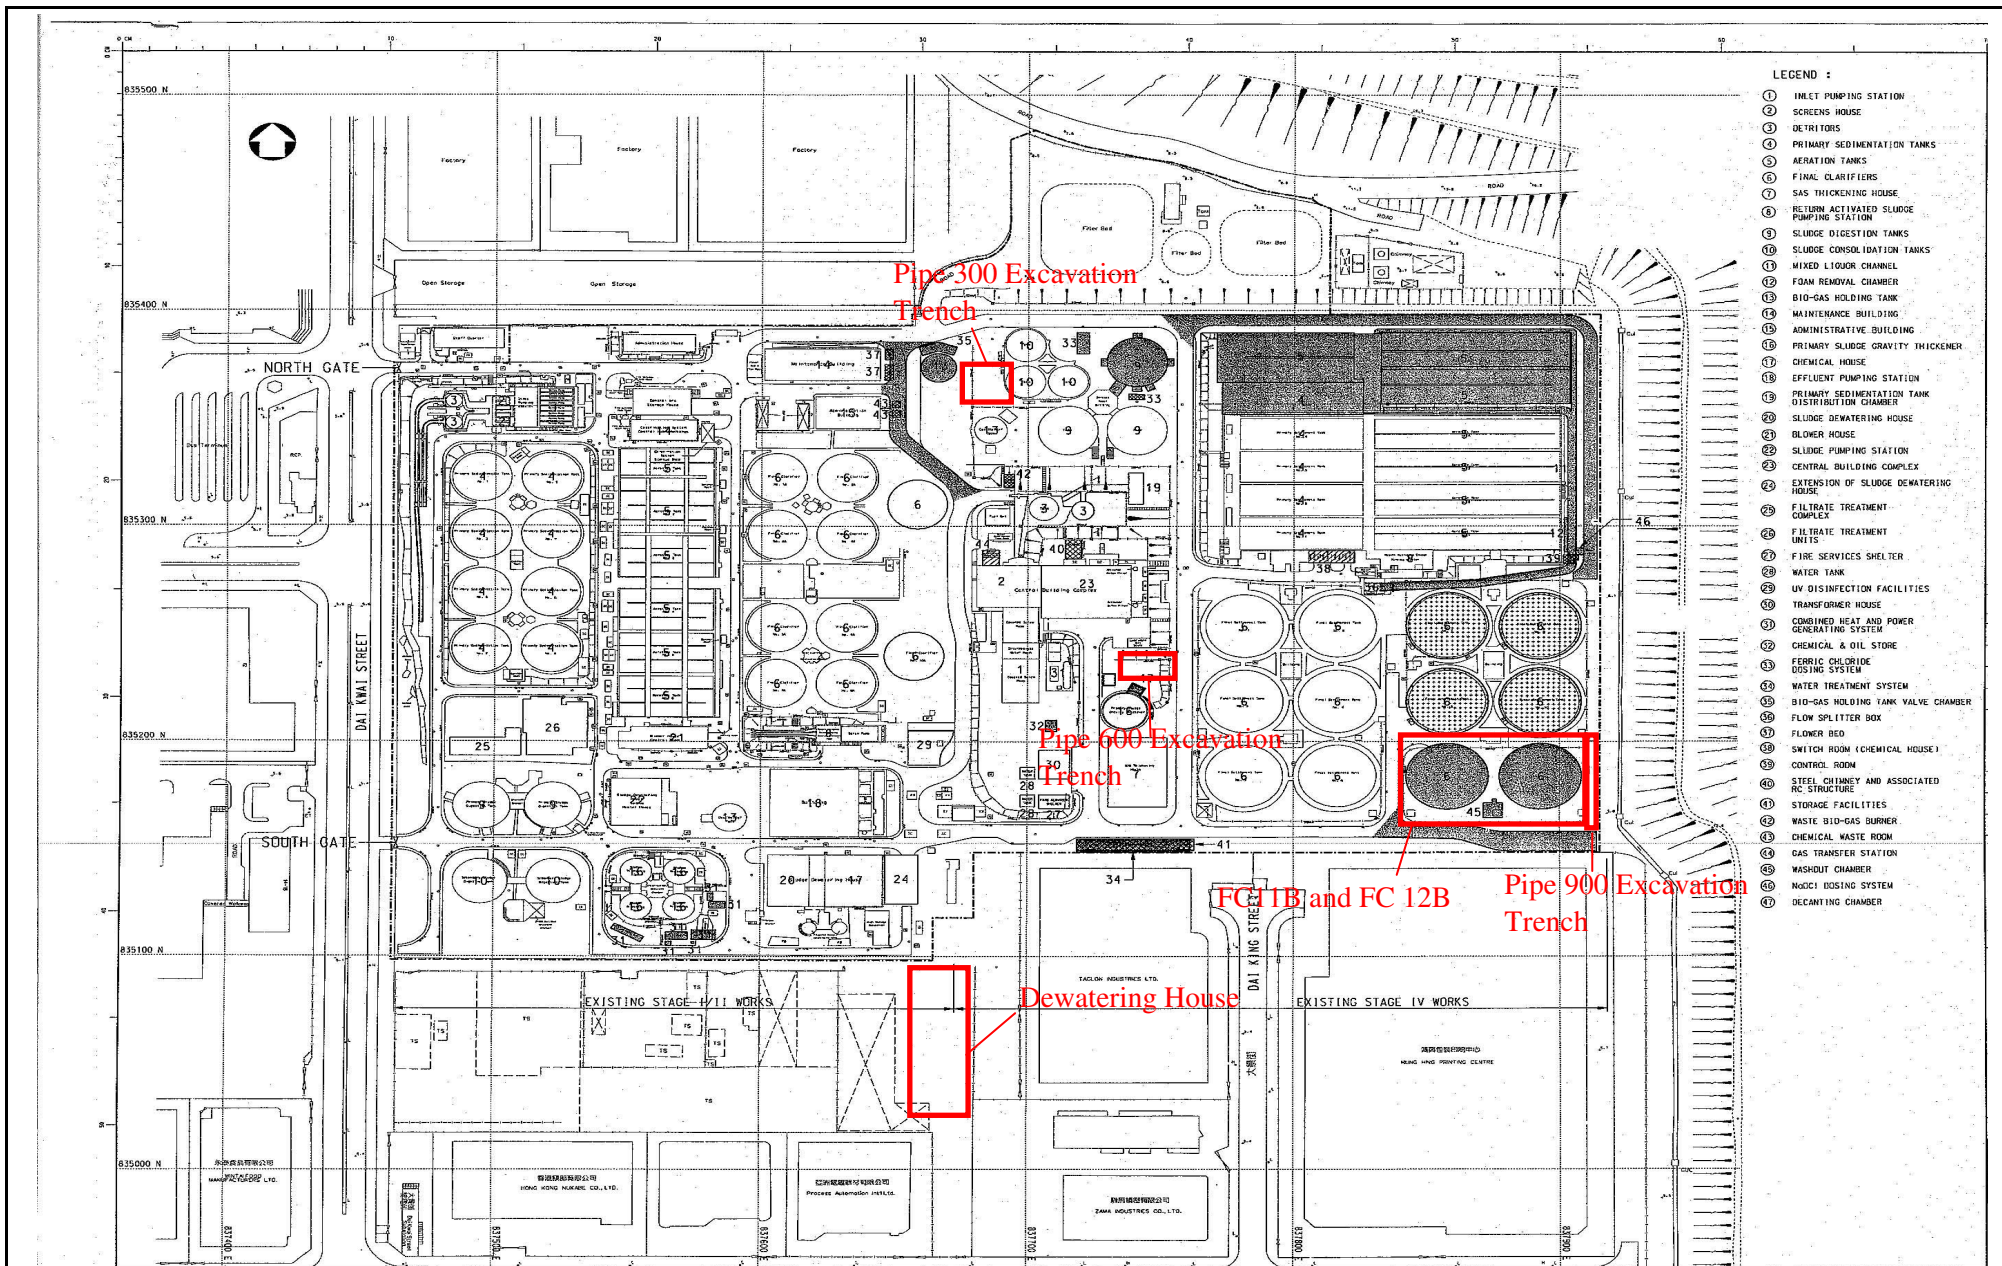

- LEGEND :
- ① INLET PUMPING STATION
  - ② SCREENS HOUSE
  - ③ DETRIOTORS
  - ④ PRIMARY SEDIMENTATION TANKS
  - ⑤ AERATION TANKS
  - ⑥ FINAL CLARIFIERS
  - ⑦ SAS THICKENING HOUSE
  - ⑧ RETURN ACTIVATED SLUDGE PUMPING STATION
  - ⑨ SLUDGE DIGESTION TANKS
  - ⑩ SLUDGE CONSOLIDATION TANKS
  - ⑪ MIXED LIQUOR CHANNEL
  - ⑫ FOAM REMOVAL CHAMBER
  - ⑬ BIO-GAS HOLDING TANK
  - ⑭ MAINTENANCE BUILDING
  - ⑮ ADMINISTRATIVE BUILDING
  - ⑯ PRIMARY SLUDGE GRAVITY THICKENER
  - ⑰ CHEMICAL HOUSE
  - ⑱ EFFLUENT PUMPING STATION
  - ⑲ PRIMARY SEDIMENTATION TANK DISTRIBUTION CHAMBER
  - ⑳ SLUDGE DEWATERING HOUSE
  - ㉑ BLOWER HOUSE
  - ㉒ SLUDGE PUMPING STATION
  - ㉓ CENTRAL BUILDING COMPLEX
  - ㉔ EXTENSION OF SLUDGE DEWATERING HOUSE
  - ㉕ FILTRATE TREATMENT COMPLEX
  - ㉖ FILTRATE TREATMENT UNITS
  - ㉗ FIRE SERVICES SHELTER
  - ㉘ WATER TANK
  - ㉙ UV DISINFECTION FACILITIES
  - ㉚ TRANSFORMER HOUSE
  - ㉛ COMBINED HEAT AND POWER GENERATING SYSTEM
  - ㉜ CHEMICAL & OIL STORE
  - ㉝ FERRIC CHLORIDE DOSING SYSTEM
  - ㉞ WATER TREATMENT SYSTEM
  - ㉟ BIO-GAS HOLDING TANK VALVE CHAMBER
  - ⓫ FLOW SPLITTER BOX
  - ⓬ FLOWER BED
  - ⓭ SWITCH ROOM (CHEMICAL HOUSE)
  - ⓮ CONTROL ROOM
  - ⓯ STEEL CHIMNEY AND ASSOCIATED RC STRUCTURE
  - ⓰ STORAGE FACILITIES
  - ⓱ WASTE BIO-GAS BURNER
  - ⓲ CHEMICAL WASTE ROOM
  - ⓳ GAS TRANSFER STATION
  - ⓴ WASHOUT CHAMBER
  - ⓵ NODICI DOSING SYSTEM
  - ⓶ DECATING CHAMBER

TAI PO SEWAGE TREATMENT WORKS, STAGE V, PHASE IIB

Landfill Gas Monitoring Area(TPSTW)

|       |        |
|-------|--------|
| Scale | N.T.S  |
| Date  | Mar-11 |

|             |        |
|-------------|--------|
| Project No. | MA0010 |
| Figure      | 1.3    |



---

---

**APPENDIX A  
ACTION AND LIMIT LEVELS**

---

---

**APPENDIX A – Action and Limit Levels****1-Hour TSP**

| Location | Action Level, $\mu\text{g}/\text{m}^3$ | Limit Level, $\mu\text{g}/\text{m}^3$ |
|----------|----------------------------------------|---------------------------------------|
| CAM1     | 315                                    | 500                                   |
| CAM2     | 336                                    |                                       |
| CAM3     | 344                                    |                                       |

**24-Hour TSP**

| Location | Action Level, $\mu\text{g}/\text{m}^3$ | Limit Level, $\mu\text{g}/\text{m}^3$ |
|----------|----------------------------------------|---------------------------------------|
| CAM1     | 171                                    | 260                                   |
| CAM2     | 177                                    |                                       |
| CAM3     | 192                                    |                                       |

**Construction Noise**

| Time Period                                                    | Action Level                              | Limit Level |
|----------------------------------------------------------------|-------------------------------------------|-------------|
| 0700-1900 hrs on normal weekdays                               | When one documented complaint is received | 75 dB(A)    |
| 0700-2300 hrs on holidays; and 1900-2300 hrs on all other days |                                           | 70* dB(A)   |
| 2300-0700 hrs of next day                                      |                                           | 55* dB(A)   |

Notes:

\* The Area Sensitivity Rating for Station NM1 is taken as C, due to the nearby industrial area, according to Table 1 of EPD's Technical Memorandum on Noise from Construction Work other than Percussive Piling.

**Landfill Gas**

| <b>Parameter</b> | <b>Limit Level</b>              | <b>Action</b>                                                                                                |
|------------------|---------------------------------|--------------------------------------------------------------------------------------------------------------|
| Oxygen           | <19%                            | Ventilate to restore oxygen to >19%                                                                          |
|                  | <18%                            | Stop works<br>Evacuate personnel / prohibit entry<br>Increase ventilation to restore oxygen to >19%          |
| Methane          | >10% LEL (i.e. >0.5% by volume) | Post “No Smoking” signs<br>Prohibit hot works<br>Ventilate to restore methane to <10% LEL                    |
|                  | >20% LEL (i.e. >1% by volume)   | Stop works<br>Evacuate personnel / prohibit entry<br>Increase ventilation to restore methane to <10%         |
| Carbon Dioxide   | >0.5%                           | Ventilate to restore carbon dioxide to <0.5%                                                                 |
|                  | >1.5%                           | Stop works<br>Evacuate personnel / prohibit entry<br>Increase ventilation to restore carbon dioxide to <0.5% |

---

---

**APPENDIX B  
COPIES OF CALIBRATION  
CERTIFICATES**

---

---

# High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

**CINOTECH**

File No. MA0010/37/0036

Station CAMI - Government Staff Quarter

Operator: CH

Date: 24-Jan-11

Next Due Date: 23-Mar-11

Equipment No.: A-01-37

Serial No. 1704

| Ambient Condition   |     |                     |       |
|---------------------|-----|---------------------|-------|
| Temperature, Ta (K) | 288 | Pressure, Pa (mmHg) | 769.2 |

| Orifice Transfer Standard Information |           |                                                                          |        |               |         |
|---------------------------------------|-----------|--------------------------------------------------------------------------|--------|---------------|---------|
| Equipment No.:                        | A-04-01   | Slope, mc                                                                | 0.0462 | Intercept, bc | -0.0163 |
| Last Calibration Date:                | 11-Oct-10 | $mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ |        |               |         |
| Next Calibration Date:                | 9-Oct-11  | $Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$  |        |               |         |

| Calibration of TSP Sampler |                            |                                           |                        |                      |                                                  |
|----------------------------|----------------------------|-------------------------------------------|------------------------|----------------------|--------------------------------------------------|
| Calibration Point          | Orifice                    |                                           |                        | HVS                  |                                                  |
|                            | ΔH (orifice), in. of water | [ΔH x (Pa/760) x (298/Ta)] <sup>1/2</sup> | Qstd (CFM)<br>X - axis | ΔW (HVS), in. of oil | [ΔW x (Pa/760) x (298/Ta)] <sup>1/2</sup> Y-axis |
| 1                          | 11.8                       | 3.52                                      | 76.44                  | 7.6                  | 2.82                                             |
| 2                          | 9.8                        | 3.20                                      | 69.69                  | 6.2                  | 2.55                                             |
| 3                          | 7.4                        | 2.78                                      | 60.61                  | 5.0                  | 2.29                                             |
| 4                          | 5.2                        | 2.33                                      | 50.86                  | 3.3                  | 1.86                                             |
| 5                          | 3.3                        | 1.86                                      | 40.59                  | 2.0                  | 1.45                                             |

By Linear Regression of Y on X

Slope, mw = 0.0380

Intercept, bw = -0.0760

Correlation coefficient\* = 0.9980

\*If Correlation Coefficient < 0.990, check and recalibrate.

### Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM

From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W =  $(mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$  2.32

Remarks: \_\_\_\_\_

Conducted by: LM Signature: LM

Date: 24/1/2011

Checked by: W.H. Tang Signature: W.H. Tang

Date: 24.1.11





# High-Volume TSP Sampler

## 5-POINT CALIBRATION DATA SHEET

**CINOTECH**

File No. MA0010/A40/0036

Station CAM2 - Hung Hing Printing Centre Operator: CH  
 Date: 24-Jan-11 Next Due Date: 23-Mar-11  
 Equipment No.: A-01-40 Serial No. 10239

| Ambient Condition   |     |                     |       |
|---------------------|-----|---------------------|-------|
| Temperature, Ta (K) | 288 | Pressure, Pa (mmHg) | 769.2 |

| Orifice Transfer Standard Information |           |                                                                          |        |               |         |
|---------------------------------------|-----------|--------------------------------------------------------------------------|--------|---------------|---------|
| Equipment No.:                        | A-04-01   | Slope, mc                                                                | 0.0462 | Intercept, bc | -0.0163 |
| Last Calibration Date:                | 11-Oct-10 | $mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ |        |               |         |
| Next Calibration Date:                | 9-Oct-11  | $Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$  |        |               |         |

| Calibration of TSP Sampler |                            |                                           |                     |                      |                                                  |
|----------------------------|----------------------------|-------------------------------------------|---------------------|----------------------|--------------------------------------------------|
| Calibration Point          | Orifice                    |                                           |                     | HVS                  |                                                  |
|                            | ΔH (orifice), in. of water | [ΔH x (Pa/760) x (298/Ta)] <sup>1/2</sup> | Qstd (CFM) X - axis | ΔW (HVS), in. of oil | [ΔW x (Pa/760) x (298/Ta)] <sup>1/2</sup> Y-axis |
| 1                          | 12.0                       | 3.54                                      | 77.08               | 8.1                  | 2.91                                             |
| 2                          | 9.9                        | 3.22                                      | 70.05               | 6.5                  | 2.61                                             |
| 3                          | 7.6                        | 2.82                                      | 61.42               | 5.2                  | 2.33                                             |
| 4                          | 5.1                        | 2.31                                      | 50.38               | 3.2                  | 1.83                                             |
| 5                          | 3.0                        | 1.77                                      | 38.72               | 1.9                  | 1.41                                             |

By Linear Regression of Y on X  
 Slope, mw = 0.0393 Intercept, bw : -0.1176  
 Correlation coefficient\* = 0.9989  
 \*If Correlation Coefficient < 0.990, check and recalibrate.

**Set Point Calculation**

From the TSP Field Calibration Curve, take Qstd = 43 CFM  
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W = ( mw x Qstd + bw )<sup>2</sup> x ( 760 / Pa ) x ( Ta / 298 ) = 2.35

Remarks: \_\_\_\_\_

Conducted by: cm Signature: cm Date: 24/1/2011  
 Checked by: wk Tang Signature: Kwan Date: 24/1/2011

# High-Volume TSP Sampler

## 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA0010/A40/0037

Station CAM2 - Hung Hing Printing Centre Operator: WK  
 Date: 22-Mar-11 Next Due Date: 21-May-11  
 Equipment No.: A-01-40 Serial No. 10239

| Ambient Condition   |       |                     |       |
|---------------------|-------|---------------------|-------|
| Temperature, Ta (K) | 291.9 | Pressure, Pa (mmHg) | 765.7 |

| Orifice Transfer Standard Information |           |                                                                          |        |               |         |
|---------------------------------------|-----------|--------------------------------------------------------------------------|--------|---------------|---------|
| Equipment No.:                        | A-04-01   | Slope, mc                                                                | 0.0462 | Intercept, bc | -0.0163 |
| Last Calibration Date:                | 11-Oct-10 | $mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ |        |               |         |
| Next Calibration Date:                | 9-Oct-11  | $Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$  |        |               |         |

| Calibration of TSP Sampler |                                    |                                                    |                     |                              |                                                           |
|----------------------------|------------------------------------|----------------------------------------------------|---------------------|------------------------------|-----------------------------------------------------------|
| Calibration Point          | Orifice                            |                                                    |                     | HVS                          |                                                           |
|                            | $\Delta H$ (orifice), in. of water | $[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$ | Qstd (CFM) X - axis | $\Delta W$ (HVS), in. of oil | $[\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$ Y-axis |
| 1                          | 11.9                               | 3.50                                               | 76.08               | 8.2                          | 2.90                                                      |
| 2                          | 9.7                                | 3.16                                               | 68.72               | 6.7                          | 2.63                                                      |
| 3                          | 7.5                                | 2.78                                               | 60.47               | 5.1                          | 2.29                                                      |
| 4                          | 5.1                                | 2.29                                               | 49.93               | 3.2                          | 1.81                                                      |
| 5                          | 3.0                                | 1.76                                               | 38.37               | 1.9                          | 1.40                                                      |

By Linear Regression of Y on X

Slope, mw = 0.0406 Intercept, bw : -0.1761  
 Correlation coefficient\* = 0.9993

\*If Correlation Coefficient < 0.990, check and recalibrate.

### Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM  
 From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W =  $(mw \times Qstd + bw)^2 \times (760 / Pa) \times (Ta / 298) =$  2.39

Remarks: \_\_\_\_\_

Conducted by: Wk. Tang Signature: [Signature]  
 Checked by: [Signature] Signature: [Signature]

Date: 22/3/11  
 Date: 22 March 2011





## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

|                  |            |
|------------------|------------|
| Test Report No.: | C/A/100504 |
| Date of Issue:   | 2010-05-04 |
| Date Received:   | 2010-04-30 |
| Date Tested:     | 2010-04-30 |
| Date Completed:  | 2010-04-30 |
| Next Due Date:   | 2011-05-03 |

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

Description : RS232 Integral Vane Digital Anemometer  
 Manufacturer : AZ Instrument  
 Model No. : 451104  
 Serial No. : 9020746  
 Equipment No. : A-03-01

**Test conditions:**

Room Temperature : 22 degree Celsius  
 Relative Humidity : 68%  
 Pressure : 101.3 kPa

**Methodology:**

The anemometer has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

**Results:**

|                             | Reference Set Point | Instrument Readings |
|-----------------------------|---------------------|---------------------|
| Measuring Air Velocity, m/s | 2.00                | 2.00                |
| Temperature, °C             | 21.0                | 21.0                |

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**



**PATRICK TSE**  
*Laboratory Manager*

**TEST REPORT**

|                    |                     |                            |                 |
|--------------------|---------------------|----------------------------|-----------------|
| <b>Description</b> | Calibration Orifice | <b>Manufacturer</b>        | Thermo Andersen |
| <b>Serial No.</b>  | 1536                | <b>Temperature, Ta (K)</b> | 295             |
| <b>Model No.</b>   | G25A                | <b>Pressure, Pa (mmHg)</b> | 751.5           |
| <b>Date</b>        | 11 October 2010     |                            |                 |

| Plate | Diff.Vol (m <sup>3</sup> ) | Diff.Time (min) | Diff.Hg (mm) | Diff.H <sub>2</sub> O (in.) |
|-------|----------------------------|-----------------|--------------|-----------------------------|
| 1     | 1.00                       | 1.3050          | 3.8          | 1.50                        |
| 2     | 1.00                       | 0.9250          | 7.6          | 3.00                        |
| 3     | 1.00                       | 0.8540          | 8.9          | 3.50                        |
| 4     | 1.00                       | 0.7530          | 11.4         | 4.50                        |
| 5     | 1.00                       | 0.6210          | 16.5         | 6.50                        |

**DATA TABULATION**

| Vstd   | (X axis)<br>Qstd | (Y axis) |
|--------|------------------|----------|
| 0.9938 | 0.7615           | 1.2240   |
| 0.9888 | 1.0689           | 1.7311   |
| 0.9870 | 1.1558           | 1.8698   |
| 0.9837 | 1.3064           | 2.1201   |
| 0.9769 | 1.5732           | 2.5481   |

Y axis=  $\text{SQRT}[\text{H}_2\text{O}(\text{Pa}/760)(298/\text{Ta})]$   
**Qstd Slope ( m ) = 1.63228**  
**Intercept ( b ) = -0.01631**  
**Coefficient ( r ) = 0.99998**

| Va     | (X axis)<br>Qa | (Y axis) |
|--------|----------------|----------|
| 0.9949 | 0.7624         | 0.7674   |
| 0.9899 | 1.0701         | 1.0852   |
| 0.9882 | 1.1571         | 1.1722   |
| 0.9848 | 1.3079         | 1.3291   |
| 0.9780 | 1.5749         | 1.5974   |

Y axis=  $\text{SQRT}[\text{H}_2\text{O}(\text{Ta}/\text{Pa})]$   
**Qa Slope ( m ) = 1.02211**  
**Intercept ( b ) = -0.01022**  
**Coefficient ( r ) = 0.99998**

**CALCULATIONS**

$V_{std} = \text{Diff. Vol}[(\text{Pa} - \text{Diff. Hg})/760](298/\text{Ta})$   
 $Q_{std} = V_{std}/\text{Time}$   
 $V_a = \text{Diff. Vol}[(\text{Pa} - \text{Diff. Hg})/\text{Pa}]$   
 $Q_a = V_a/\text{Time}$


**For subsequent flow rate calculations:**  
 $Q_{std} = 1/m\{[\text{SQRT}(\text{H}_2\text{O}(\text{Pa}/760)(298/\text{Ta}))] - b\}$   
 $Q_a = 1/m\{[\text{SQRT}(\text{H}_2\text{O}(\text{Ta}/\text{Pa}))] - b\}$

PREPARED AND CHECKED BY:  
 For and On Behalf of **WELLAB Ltd.**



**PATRICK TSE**  
 Laboratory Manager

**TEST REPORT**

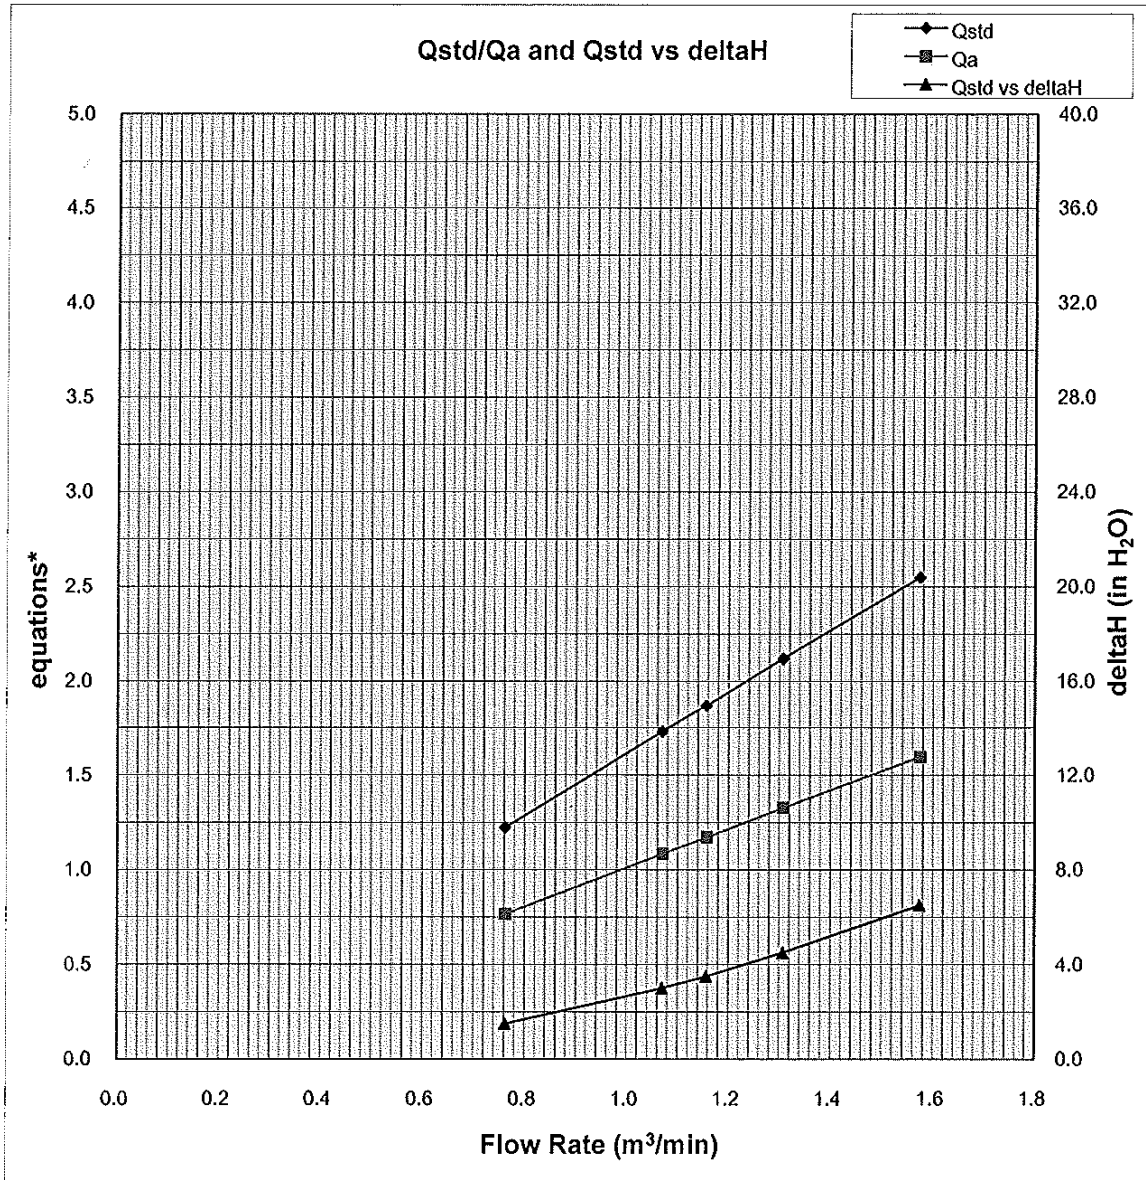

Y-axis equations:

Qstd series:  $\text{SQRT}[\Delta H(\text{Pa}/\text{Pstd})(\text{Tstd}/\text{Ta})]$

Qa series:  $\text{SQRT}[\Delta H(\text{Ta}/\text{Pa})]$

### TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

|                  |              |
|------------------|--------------|
| Test Report No.: | C/N/100924/3 |
| Date of Issue:   | 2009-09-24   |
| Date Received:   | 2010-09-22   |
| Date Tested:     | 2010-09-22   |
| Date Completed:  | 2010-09-24   |
| Next Due Date:   | 2011-09-23   |

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

|                |                                           |
|----------------|-------------------------------------------|
| Description    | : 'SVANTEK' Integrating Sound Level Meter |
| Manufacturer   | : SVANTEK                                 |
| Model No.      | : SVAN 955                                |
| Serial No.     | : 12563                                   |
| Microphone No. | : 34377                                   |
| Equipment No.  | : N-08-03                                 |

**Test conditions:**

|                   |                     |
|-------------------|---------------------|
| Room Temperature  | : 22 degree Celsius |
| Relative Humidity | : 59%               |

**Test Specifications:**

Performance checking at 94 and 114 dB

**Methodology:**

In-house method, according to manufacturer instruction manual

**Results:**

| Reference Set Point, dB | Instrument Readings, dB |
|-------------------------|-------------------------|
| 94                      | 94.0                    |
| 114                     | 114.0                   |

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**

  
**PATRICK TSE**  
Laboratory Manager



## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

|                  |              |
|------------------|--------------|
| Test Report No.: | C/N/110124/1 |
| Date of Issue:   | 2011-01-24   |
| Date Received:   | 2011-01-21   |
| Date Tested:     | 2011-01-21   |
| Date Completed:  | 2011-01-24   |
| Next Due Date:   | 2012-01-23   |

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

|                |                                           |
|----------------|-------------------------------------------|
| Description    | : 'SVANTEK' Integrating Sound Level Meter |
| Manufacturer   | : SVANTEK                                 |
| Model No.      | : SVAN 955                                |
| Serial No.     | : 14303                                   |
| Microphone No. | : 17204                                   |
| Equipment No.  | : N-08-05                                 |

**Test conditions:**

|                   |                     |
|-------------------|---------------------|
| Room Temperature  | : 23 degree Celsius |
| Relative Humidity | : 55%               |

**Test Specifications:**

Performance checking at 94 and 114 dB

**Methodology:**


In-house method, according to manufacturer instruction manual

**Results:**

| Reference Set Point, dB | Instrument Readings, dB |
|-------------------------|-------------------------|
| 94                      | 94.0                    |
| 114                     | 114.0                   |

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**



**PATRICK TSE**

Laboratory Manager

### TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

|                  |              |
|------------------|--------------|
| Test Report No.: | C/N/100527-2 |
| Date of Issue:   | 2010-05-27   |
| Date Received:   | 2010-05-26   |
| Date Tested:     | 2010-05-26   |
| Date Completed:  | 2010-05-27   |
| Next Due Date:   | 2011-05-26   |

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Certificate of Calibration

**Item for calibration:**

|                |                                 |
|----------------|---------------------------------|
| Description    | : Integrating Sound Level Meter |
| Manufacturer   | : Brüel & Kjær                  |
| Model No.      | : 2250 Light                    |
| Serial No.     | : 2681378                       |
| Microphone No. | : 2674175                       |
| Equipment No.  | : N-11-02                       |

**Test conditions:**

|                   |                     |
|-------------------|---------------------|
| Room Temperature  | : 21 degree Celsius |
| Relative Humidity | : 60%               |

**Test Specifications:**

Performance checking at 94 and 114 dB

**Methodology:**

In-house method, according to manufacturer instruction manual

**Results:**

| Reference Set Point, dB | Instrument Readings, dB |
|-------------------------|-------------------------|
| 94                      | 94.0                    |
| 114                     | 114.0                   |

*PREPARED AND CHECKED BY:*

For and On Behalf of **WELLAB Ltd.**



**PATRICK TSE**

Laboratory Manager

## TEST REPORT

**APPLICANT:** Cinotech Consultants Limited  
Room 1710, Technology Park,  
18 On Lai Street,  
Shatin, NT, Hong Kong

|                  |              |
|------------------|--------------|
| Test Report No.: | C/N/101110/1 |
| Date of Issue:   | 2010-11-10   |
| Date Received:   | 2010-11-08   |
| Date Tested:     | 2010-11-08   |
| Date Completed:  | 2010-11-10   |
| Next Due Date:   | 2011-11-09   |

**ATTN:** Mr. Henry Leung

Page: 1 of 1

### Item for calibration:

|               |                         |
|---------------|-------------------------|
| Description   | : Acoustical Calibrator |
| Manufacturer  | : SVANTEK               |
| Model No.     | : SV30A                 |
| Serial No.    | : 10965                 |
| Equipment No. | : N-09-02               |

### Test conditions:

|                   |                     |
|-------------------|---------------------|
| Room Temperature  | : 22 degree Celsius |
| Relative Humidity | : 57%               |

### Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

### Results:

| Sound Pressure Level (1kHz) | Measured SPL | Tolerance      |
|-----------------------------|--------------|----------------|
| At 94 dB SPL                | 94.0         | 94.0 ± 0.1 dB  |
| At 114 dB SPL               | 114.0        | 114.0 ± 0.1 dB |

*PREPARED AND CHECKED BY:*  
For and On Behalf of **WELLAB Ltd.**

  
**PATRICK TSE**  
Laboratory Manager

---

---

**APPENDIX C  
ENVIRONMENTAL MONITORING  
SCHEDULE**

---

---

**Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B  
Impact Air Quality and Noise Monitoring Schedule for March 2011**

| Sunday        | Monday                | Tuesday                        | Wednesday | Thursday              | Friday    | Saturday  |
|---------------|-----------------------|--------------------------------|-----------|-----------------------|-----------|-----------|
|               |                       | 1-Mar                          | 2-Mar     | 3-Mar                 | 4-Mar     | 5-Mar     |
|               |                       | 1 hr TSP<br>Noise<br>24 hr TSP | 1 hr TSP  | 1 hr TSP              |           |           |
| <b>6-Mar</b>  | 7-Mar                 | 8-Mar                          | 9-Mar     | 10-Mar                | 11-Mar    | 12-Mar    |
|               | 1 hr TSP<br>24 hr TSP | 1 hr TSP                       |           | 1 hr TSP<br>Noise     |           | 24 hr TSP |
| <b>13-Mar</b> | 14-Mar                | 15-Mar                         | 16-Mar    | 17-Mar                | 18-Mar    | 19-Mar    |
|               | 1 hr TSP              | 1 hr TSP<br>Noise              |           | 1 hr TSP              | 24 hr TSP |           |
| <b>20-Mar</b> | 21-Mar                | 22-Mar                         | 23-Mar    | 24-Mar                | 25-Mar    | 26-Mar    |
|               |                       | 1 hr TSP<br>Noise              |           | 1 hr TSP<br>24 hr TSP | 1 hr TSP  |           |
| <b>27-Mar</b> | 28-Mar                | 29-Mar                         | 30-Mar    | 31-Mar                |           |           |
|               |                       | 1 hr TSP<br>Noise              | 24 hr TSP | 1 hr TSP              |           |           |

**Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B  
Tentative Impact Air Quality and Noise Monitoring Schedule for April 2011**

| Sunday        | Monday                | Tuesday                        | Wednesday | Thursday              | Friday    | Saturday  |
|---------------|-----------------------|--------------------------------|-----------|-----------------------|-----------|-----------|
|               |                       | 1-Mar                          | 2-Mar     | 3-Mar                 | 4-Mar     | 5-Mar     |
|               |                       | 1 hr TSP<br>Noise<br>24 hr TSP | 1 hr TSP  | 1 hr TSP              |           |           |
| <b>6-Mar</b>  | 7-Mar                 | 8-Mar                          | 9-Mar     | 10-Mar                | 11-Mar    | 12-Mar    |
|               | 1 hr TSP<br>24 hr TSP | 1 hr TSP                       |           | 1 hr TSP<br>Noise     |           | 24 hr TSP |
| <b>13-Mar</b> | 14-Mar                | 15-Mar                         | 16-Mar    | 17-Mar                | 18-Mar    | 19-Mar    |
|               | 1 hr TSP              | 1 hr TSP<br>Noise              |           | 1 hr TSP              | 24 hr TSP |           |
| <b>20-Mar</b> | 21-Mar                | 22-Mar                         | 23-Mar    | 24-Mar                | 25-Mar    | 26-Mar    |
|               |                       | 1 hr TSP<br>Noise              |           | 1 hr TSP<br>24 hr TSP | 1 hr TSP  |           |
| <b>27-Mar</b> | 28-Mar                | 29-Mar                         | 30-Mar    | 31-Mar                |           |           |
|               |                       | 1 hr TSP<br>Noise              | 24 hr TSP | 1 hr TSP              |           |           |

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

---

---

**APPENDIX D  
1-HOUR TSP MONITORING RESULTS  
AND GRAPHICAL PRESENTATION**

---

---

## Appendix D - 1-hour TSP Monitoring Results

### Station CAM1

### Government Staff Quarters

| Date      | Sampling Time | Weather Condition | Air Temp. (K) | Atmospheric Pressure (Pa) | Filter Weight (g) |        | Particulate weight (g) | Elapse Time |         | Sampling Time(hrs.) | Flow Rate (m <sup>3</sup> /min.) |       | Av. flow (m <sup>3</sup> /min) | Total vol. (m <sup>3</sup> ) | Conc. (µg/m <sup>3</sup> ) |
|-----------|---------------|-------------------|---------------|---------------------------|-------------------|--------|------------------------|-------------|---------|---------------------|----------------------------------|-------|--------------------------------|------------------------------|----------------------------|
|           |               |                   |               |                           | Initial           | Final  |                        | Initial     | Final   |                     | Initial                          | Final |                                |                              |                            |
| 1-Mar-11  | 9:00          | Sunny             | 292.9         | 765.1                     | 3.1637            | 3.1781 | 0.0144                 | 15453.1     | 15454.1 | 1.0                 | 1.20                             | 1.20  | 1.20                           | 72.0                         | 200                        |
| 2-Mar-11  | 14:00         | Sunny             | 288.9         | 767.6                     | 3.1966            | 3.2052 | 0.0086                 | 15478.1     | 15479.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.6                         | 119                        |
| 3-Mar-11  | 9:00          | Sunny             | 290.4         | 767.9                     | 3.1867            | 3.2000 | 0.0133                 | 15479.1     | 15480.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.4                         | 184                        |
| 7-Mar-11  | 9:00          | Cloudy            | 291.4         | 766.3                     | 3.1548            | 3.1675 | 0.0127                 | 15480.1     | 15481.1 | 1.0                 | 1.20                             | 1.20  | 1.20                           | 72.2                         | 176                        |
| 8-Mar-11  | 14:30         | Cloudy            | 289.5         | 767.9                     | 3.3976            | 3.4061 | 0.0085                 | 15505.1     | 15506.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.5                         | 117                        |
| 10-Mar-11 | 9:00          | Cloudy            | 288.4         | 770.7                     | 3.3822            | 3.3927 | 0.0105                 | 15506.1     | 15507.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.8                         | 144                        |
| 14-Mar-11 | 15:50         | Sunny             | 298.8         | 762.1                     | 3.2259            | 3.2381 | 0.0122                 | 15531.1     | 15532.1 | 1.0                 | 1.19                             | 1.19  | 1.19                           | 71.2                         | 171                        |
| 15-Mar-11 | 9:00          | Sunny             | 283.9         | 766.3                     | 3.3177            | 3.3353 | 0.0176                 | 15532.1     | 15533.1 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.1                         | 241                        |
| 17-Mar-11 | 9:00          | Sunny             | 287.9         | 770.8                     | 3.3948            | 3.4042 | 0.0094                 | 15533.1     | 15534.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.8                         | 129                        |
| 22-Mar-11 | 10:15         | Sunny             | 293.5         | 762.5                     | 3.3552            | 3.3652 | 0.0100                 | 15558.1     | 15559.1 | 1.0                 | 1.20                             | 1.20  | 1.20                           | 71.8                         | 139                        |
| 24-Mar-11 | 9:00          | Sunny             | 289.1         | 770.2                     | 3.3755            | 3.3830 | 0.0075                 | 15559.1     | 15560.1 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.1                         | 103                        |
| 25-Mar-11 | 15:00         | Sunny             | 293.6         | 768.1                     | 3.3698            | 3.3867 | 0.0169                 | 15584.1     | 15585.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.5                         | 233                        |
| 29-Mar-11 | 13:00         | Sunny             | 290.9         | 770.9                     | 3.3489            | 3.3568 | 0.0079                 | 15585.1     | 15586.1 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 72.9                         | 108                        |
| 31-Mar-11 | 10:20         | Sunny             | 290.9         | 767.6                     | 3.3656            | 3.3683 | 0.0027                 | 15610.1     | 15611.1 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.8                         | 37                         |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Min                          | 37                         |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Max                          | 241                        |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Average                      | 150                        |

### Station CAM2

### Heng Hing Printing Centre

| Date      | Sampling Time | Weather Condition | Air Temp. (K) | Atmospheric Pressure (Pa) | Filter Weight (g) |        | Particulate weight (g) | Elapse Time |         | Sampling Time(hrs.) | Flow Rate (m <sup>3</sup> /min.) |       | Av. flow (m <sup>3</sup> /min) | Total vol. (m <sup>3</sup> ) | Conc. (µg/m <sup>3</sup> ) |
|-----------|---------------|-------------------|---------------|---------------------------|-------------------|--------|------------------------|-------------|---------|---------------------|----------------------------------|-------|--------------------------------|------------------------------|----------------------------|
|           |               |                   |               |                           | Initial           | Final  |                        | Initial     | Final   |                     | Initial                          | Final |                                |                              |                            |
| 1-Mar-11  | 9:00          | Sunny             | 292.9         | 765.1                     | 3.1309            | 3.1427 | 0.0118                 | 24630.2     | 24631.2 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.8                         | 162                        |
| 2-Mar-11  | 14:00         | Sunny             | 288.9         | 767.6                     | 3.2125            | 3.2227 | 0.0102                 | 24655.2     | 24656.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.4                         | 139                        |
| 3-Mar-11  | 9:00          | Sunny             | 290.4         | 767.9                     | 3.1813            | 3.1987 | 0.0174                 | 24656.2     | 24657.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.2                         | 238                        |
| 7-Mar-11  | 9:00          | Cloudy            | 291.4         | 766.3                     | 3.3591            | 3.3759 | 0.0168                 | 24657.2     | 24658.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.0                         | 230                        |
| 8-Mar-11  | 14:30         | Cloudy            | 289.5         | 767.9                     | 3.3304            | 3.3395 | 0.0091                 | 24682.2     | 24683.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.3                         | 124                        |
| 10-Mar-11 | 9:00          | Cloudy            | 288.4         | 770.7                     | 3.3920            | 3.4022 | 0.0102                 | 24683.2     | 24684.2 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.6                         | 139                        |
| 14-Mar-11 | 15:50         | Sunny             | 298.8         | 762.1                     | 3.3694            | 3.3834 | 0.0140                 | 24708.2     | 24709.2 | 1.0                 | 1.20                             | 1.20  | 1.20                           | 72.0                         | 194                        |
| 15-Mar-11 | 9:00          | Sunny             | 283.9         | 766.3                     | 3.3527            | 3.3714 | 0.0187                 | 24709.2     | 24710.2 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.9                         | 253                        |
| 17-Mar-11 | 9:00          | Sunny             | 287.9         | 770.8                     | 3.3793            | 3.3896 | 0.0103                 | 24710.2     | 24711.2 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.7                         | 140                        |
| 22-Mar-11 | 10:07         | Sunny             | 293.5         | 762.5                     | 3.3859            | 3.3990 | 0.0131                 | 24735.2     | 24736.2 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.6                         | 180                        |
| 24-Mar-11 | 9:00          | Sunny             | 289.1         | 770.2                     | 3.4127            | 3.4233 | 0.0106                 | 24736.2     | 24737.2 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.6                         | 144                        |
| 25-Mar-11 | 15:00         | Sunny             | 293.6         | 768.1                     | 3.3898            | 3.4067 | 0.0169                 | 24761.2     | 24762.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.0                         | 232                        |
| 29-Mar-11 | 13:00         | Sunny             | 290.9         | 770.9                     | 3.3682            | 3.3789 | 0.0107                 | 24762.2     | 24763.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.4                         | 146                        |
| 31-Mar-11 | 10:20         | Sunny             | 290.9         | 767.6                     | 3.3945            | 3.4010 | 0.0065                 | 24787.2     | 24788.2 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.3                         | 89                         |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Min                          | 89                         |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Max                          | 253                        |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Average                      | 172                        |






## Appendix D - 1-hour TSP Monitoring Results

Station CAM3

Talcon Industrial Ltd

| Date      | Sampling Time | Weather Condition | Air Temp. (K) | Atmospheric Pressure (Pa) | Filter Weight (g) |        | Particulate weight (g) | Elapse Time |         | Sampling Time(hrs.) | Flow Rate (m <sup>3</sup> /min.) |       | Av. flow (m <sup>3</sup> /min) | Total vol. (m <sup>3</sup> ) | Conc. (µg/m <sup>3</sup> ) |
|-----------|---------------|-------------------|---------------|---------------------------|-------------------|--------|------------------------|-------------|---------|---------------------|----------------------------------|-------|--------------------------------|------------------------------|----------------------------|
|           |               |                   |               |                           | Initial           | Final  |                        | Initial     | Final   |                     | Initial                          | Final |                                |                              |                            |
| 1-Mar-11  | 9:00          | Sunny             | 292.9         | 765.1                     | 3.1238            | 3.1362 | 0.0124                 | 17893.9     | 17894.9 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.4                         | 171                        |
| 2-Mar-11  | 14:00         | Sunny             | 288.9         | 767.6                     | 3.3933            | 3.4044 | 0.0111                 | 17918.9     | 17919.9 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.0                         | 152                        |
| 3-Mar-11  | 9:00          | Sunny             | 290.4         | 767.9                     | 3.1971            | 3.2133 | 0.0162                 | 17919.9     | 17920.9 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.8                         | 222                        |
| 7-Mar-11  | 9:00          | Cloudy            | 291.4         | 766.3                     | 3.3577            | 3.3718 | 0.0141                 | 17920.9     | 17921.9 | 1.0                 | 1.21                             | 1.21  | 1.21                           | 72.7                         | 194                        |
| 8-Mar-11  | 14:30         | Cloudy            | 289.5         | 767.9                     | 3.3608            | 3.3720 | 0.0112                 | 17945.9     | 17946.9 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 72.9                         | 154                        |
| 10-Mar-11 | 9:00          | Cloudy            | 288.4         | 770.7                     | 3.3534            | 3.3683 | 0.0149                 | 17946.9     | 17947.9 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.2                         | 204                        |
| 14-Mar-11 | 15:50         | Sunny             | 298.8         | 762.1                     | 3.3688            | 3.3856 | 0.0168                 | 17971.9     | 17972.9 | 1.0                 | 1.19                             | 1.19  | 1.19                           | 71.7                         | 234                        |
| 15-Mar-11 | 9:00          | Sunny             | 283.9         | 766.3                     | 3.3749            | 3.3942 | 0.0193                 | 17972.9     | 17973.9 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.5                         | 263                        |
| 17-Mar-11 | 9:00          | Sunny             | 287.9         | 770.8                     | 3.3788            | 3.3897 | 0.0109                 | 17973.9     | 17974.9 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.2                         | 149                        |
| 22-Mar-11 | 10:10         | Sunny             | 293.5         | 762.5                     | 3.3652            | 3.3769 | 0.0117                 | 17998.9     | 17999.9 | 1.0                 | 1.20                             | 1.20  | 1.20                           | 72.3                         | 162                        |
| 24-Mar-11 | 9:00          | Sunny             | 289.1         | 770.2                     | 3.3568            | 3.3681 | 0.0113                 | 17999.9     | 18000.9 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 74.1                         | 153                        |
| 25-Mar-11 | 15:00         | Sunny             | 293.6         | 768.1                     | 3.3440            | 3.3634 | 0.0194                 | 18024.9     | 18025.9 | 1.0                 | 1.22                             | 1.22  | 1.22                           | 73.5                         | 264                        |
| 29-Mar-11 | 13:00         | Sunny             | 290.9         | 770.9                     | 3.3696            | 3.3780 | 0.0084                 | 18025.9     | 18026.9 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.9                         | 114                        |
| 31-Mar-11 | 10:20         | Sunny             | 290.9         | 767.6                     | 3.3917            | 3.3997 | 0.0080                 | 18050.9     | 18051.9 | 1.0                 | 1.23                             | 1.23  | 1.23                           | 73.7                         | 108                        |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Min                          | 108                        |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Max                          | 264                        |
|           |               |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Average                      | 182                        |

### 1-hr TSP Concentration Levels

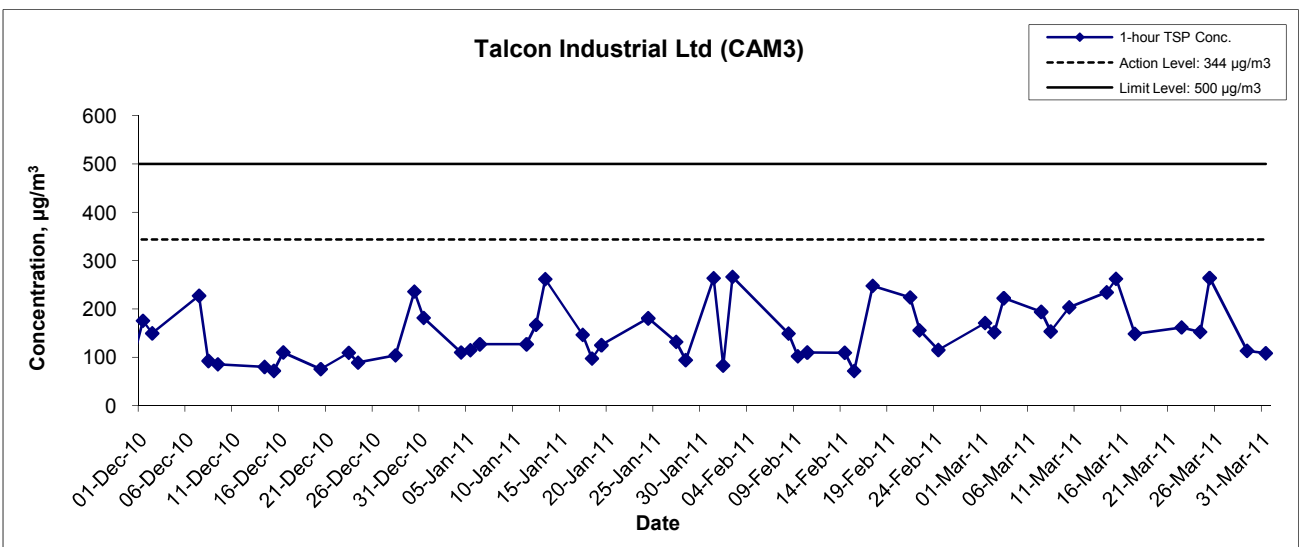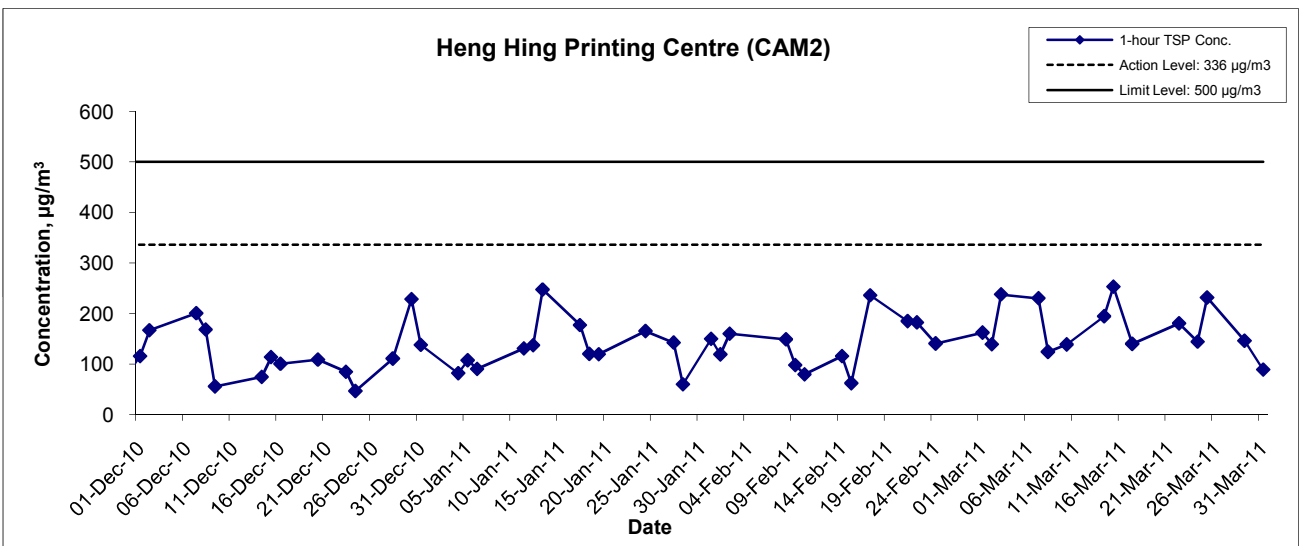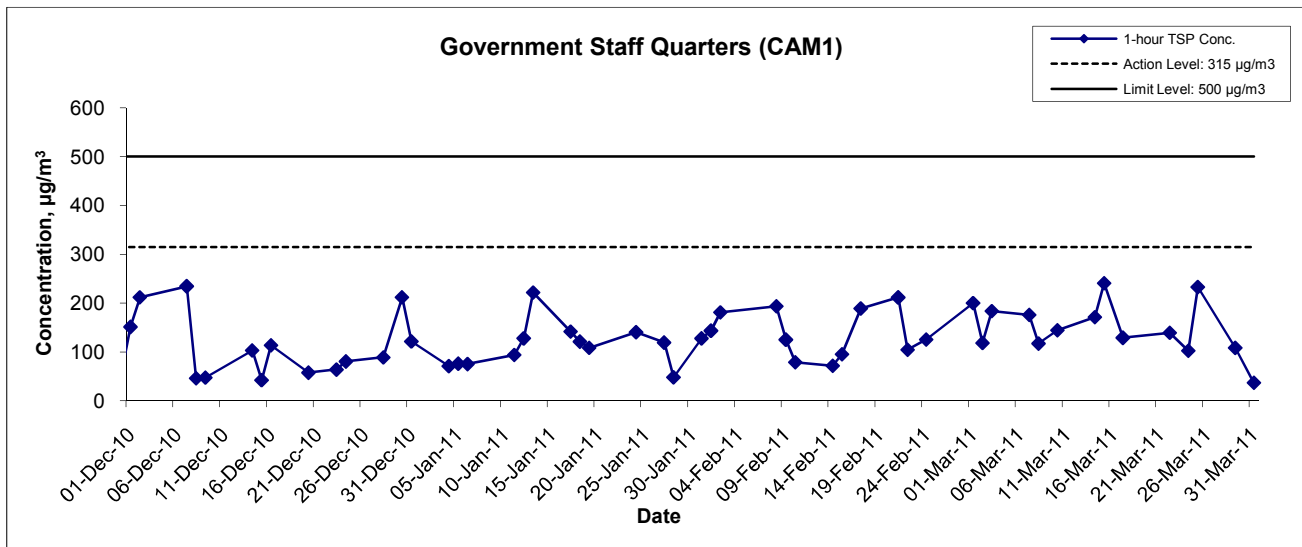

|                                                                |                                                                    |        |                    |          |
|----------------------------------------------------------------|--------------------------------------------------------------------|--------|--------------------|----------|
| Title                                                          | Contract No. DC/2009/09                                            | Scale  | Project No. MA0010 | CINOTECH |
|                                                                | Construction of Tai Po Sewage Treatment Works - Stage V Phase II B | N.T.S  |                    |          |
| Graphical Presentation of 1-hour TSP Impact Monitoring Results |                                                                    | Date   | Appendix D         |          |
|                                                                |                                                                    | Mar 11 |                    |          |

---

---

**APPENDIX E  
24-HOUR TSP MONITORING RESULTS  
AND GRAPHICAL PRESENTATION**

---

---

## Appendix E - 24-hour TSP Monitoring Results

### Station CAM1

### Government Staff Quarters

| Start Date | Weather Condition | Air Temp. (K) | Atmospheric Pressure (Pa) | Filter Weight (g) |        | Particulate weight (g) | Elapse Time |         | Sampling Time(hrs.) | Flow Rate (m <sup>3</sup> /min.) |       | Av. flow (m <sup>3</sup> /min) | Total vol. (m <sup>3</sup> ) | Conc. (µg/m <sup>3</sup> ) |
|------------|-------------------|---------------|---------------------------|-------------------|--------|------------------------|-------------|---------|---------------------|----------------------------------|-------|--------------------------------|------------------------------|----------------------------|
|            |                   |               |                           | Initial           | Final  |                        | Initial     | Final   |                     | Initial                          | Final |                                |                              |                            |
| 1-Mar-11   | Sunny             | 293.4         | 764.7                     | 3.2286            | 3.3004 | 0.0718                 | 15454.1     | 15478.1 | 24.0                | 1.20                             | 1.20  | 1.20                           | 1725.7                       | 42                         |
| 7-Mar-11   | Cloudy            | 293.7         | 764.5                     | 3.4222            | 3.6250 | 0.2028                 | 15481.1     | 15505.1 | 24.0                | 1.20                             | 1.20  | 1.20                           | 1724.6                       | 118                        |
| 12-Mar-11  | Sunny             | 290.4         | 767.6                     | 3.3288            | 3.4517 | 0.1229                 | 15507.1     | 15531.1 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1737.3                       | 71                         |
| 18-Mar-11  | Sunny             | 287.1         | 767.2                     | 3.3582            | 3.4917 | 0.1335                 | 15534.1     | 15558.1 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1746.3                       | 76                         |
| 24-Mar-11  | Sunny             | 291.4         | 767.7                     | 3.3690            | 3.5562 | 0.1872                 | 15560.1     | 15584.1 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1746.0                       | 107                        |
| 30-Mar-11  | Sunny             | 291.1         | 770.2                     | 3.3923            | 3.5663 | 0.1740                 | 15586.1     | 15610.1 | 24.0                | 1.22                             | 1.21  | 1.21                           | 1749.4                       | 99                         |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Min                          | 42                         |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Max                          | 118                        |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Average                      | 86                         |

### Station CAM2

### Heng Hing Printing Centre




| Start Date | Weather Condition | Air Temp. (K) | Atmospheric Pressure (Pa) | Filter Weight (g) |        | Particulate weight (g) | Elapse Time |         | Sampling Time(hrs.) | Flow Rate (m <sup>3</sup> /min.) |       | Av. flow (m <sup>3</sup> /min) | Total vol. (m <sup>3</sup> ) | Conc. (µg/m <sup>3</sup> ) |
|------------|-------------------|---------------|---------------------------|-------------------|--------|------------------------|-------------|---------|---------------------|----------------------------------|-------|--------------------------------|------------------------------|----------------------------|
|            |                   |               |                           | Initial           | Final  |                        | Initial     | Final   |                     | Initial                          | Final |                                |                              |                            |
| 1-Mar-11   | Sunny             | 293.4         | 764.7                     | 3.1233            | 3.2757 | 0.1524                 | 24631.2     | 24655.2 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1745.9                       | 87                         |
| 7-Mar-11   | Cloudy            | 293.7         | 764.5                     | 3.3570            | 3.5728 | 0.2158                 | 24658.2     | 24682.2 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1744.9                       | 124                        |
| 12-Mar-11  | Sunny             | 290.4         | 767.6                     | 3.3492            | 3.4818 | 0.1326                 | 24684.2     | 24708.2 | 24.0                | 1.22                             | 1.22  | 1.22                           | 1757.4                       | 75                         |
| 18-Mar-11  | Sunny             | 287.1         | 767.2                     | 3.3775            | 3.5369 | 0.1594                 | 24711.2     | 24735.2 | 24.0                | 1.23                             | 1.23  | 1.23                           | 1766.3                       | 90                         |
| 24-Mar-11  | Sunny             | 291.4         | 767.7                     | 3.4041            | 3.5840 | 0.1799                 | 24737.2     | 24761.2 | 24.0                | 1.22                             | 1.22  | 1.22                           | 1757.2                       | 102                        |
| 30-Mar-11  | Sunny             | 291.1         | 770.2                     | 3.4171            | 3.6029 | 0.1858                 | 24763.2     | 24787.2 | 24.0                | 1.22                             | 1.22  | 1.22                           | 1760.5                       | 106                        |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Min                          | 75                         |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Max                          | 124                        |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Average                      | 97                         |

### Station CAM3

### Talcon Industrial Ltd

| Start Date | Weather Condition | Air Temp. (K) | Atmospheric Pressure (Pa) | Filter Weight (g) |        | Particulate weight (g) | Elapse Time |         | Sampling Time(hrs.) | Flow Rate (m <sup>3</sup> /min.) |       | Av. flow (m <sup>3</sup> /min) | Total vol. (m <sup>3</sup> ) | Conc. (µg/m <sup>3</sup> ) |
|------------|-------------------|---------------|---------------------------|-------------------|--------|------------------------|-------------|---------|---------------------|----------------------------------|-------|--------------------------------|------------------------------|----------------------------|
|            |                   |               |                           | Initial           | Final  |                        | Initial     | Final   |                     | Initial                          | Final |                                |                              |                            |
| 1-Mar-11   | Sunny             | 293.4         | 764.7                     | 3.2168            | 3.3658 | 0.1490                 | 17894.9     | 17918.9 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1736.8                       | 86                         |
| 7-Mar-11   | Cloudy            | 293.7         | 764.5                     | 3.3794            | 3.6177 | 0.2383                 | 17921.9     | 17945.9 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1735.8                       | 137                        |
| 12-Mar-11  | Sunny             | 290.4         | 767.6                     | 3.3716            | 3.5184 | 0.1468                 | 17947.9     | 17971.9 | 24.0                | 1.21                             | 1.21  | 1.21                           | 1747.9                       | 84                         |
| 18-Mar-11  | Sunny             | 287.1         | 767.2                     | 3.3614            | 3.5834 | 0.2220                 | 17974.9     | 17998.9 | 24.0                | 1.22                             | 1.22  | 1.22                           | 1756.5                       | 126                        |
| 24-Mar-11  | Sunny             | 291.4         | 767.7                     | 3.3420            | 3.5388 | 0.1968                 | 18000.9     | 18024.9 | 24.0                | 1.23                             | 1.23  | 1.23                           | 1768.4                       | 111                        |
| 30-Mar-11  | Sunny             | 291.1         | 770.2                     | 3.3781            | 3.5262 | 0.1481                 | 18026.9     | 18050.9 | 24.0                | 1.23                             | 1.23  | 1.23                           | 1771.8                       | 84                         |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Min                          | 84                         |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Max                          | 137                        |
|            |                   |               |                           |                   |        |                        |             |         |                     |                                  |       |                                | Average                      | 105                        |

### 24-hr TSP Concentration Levels

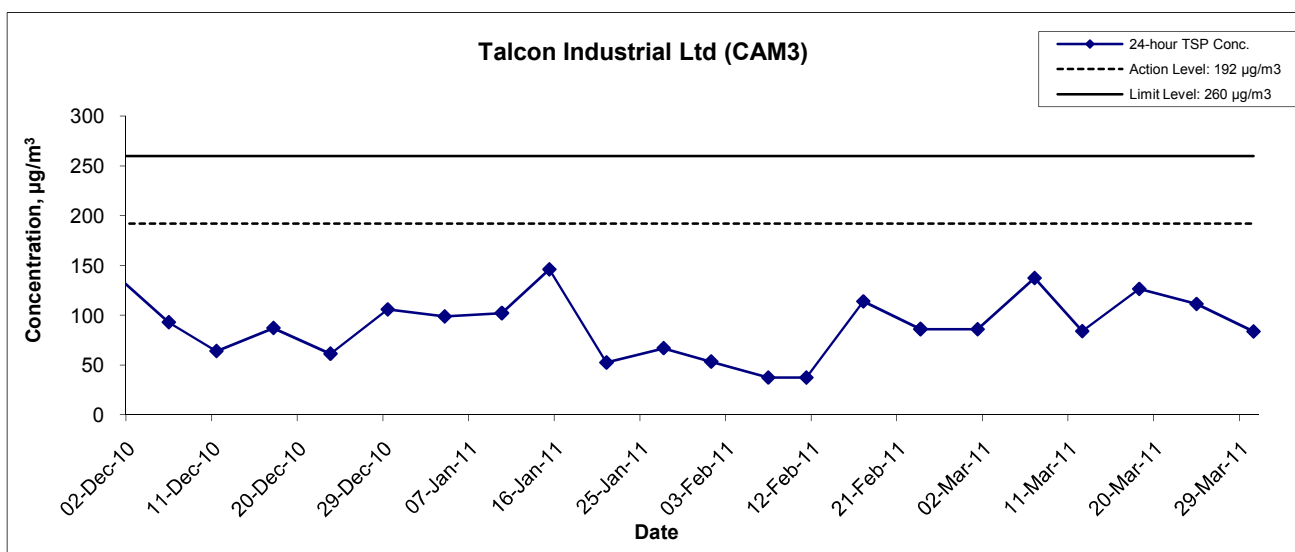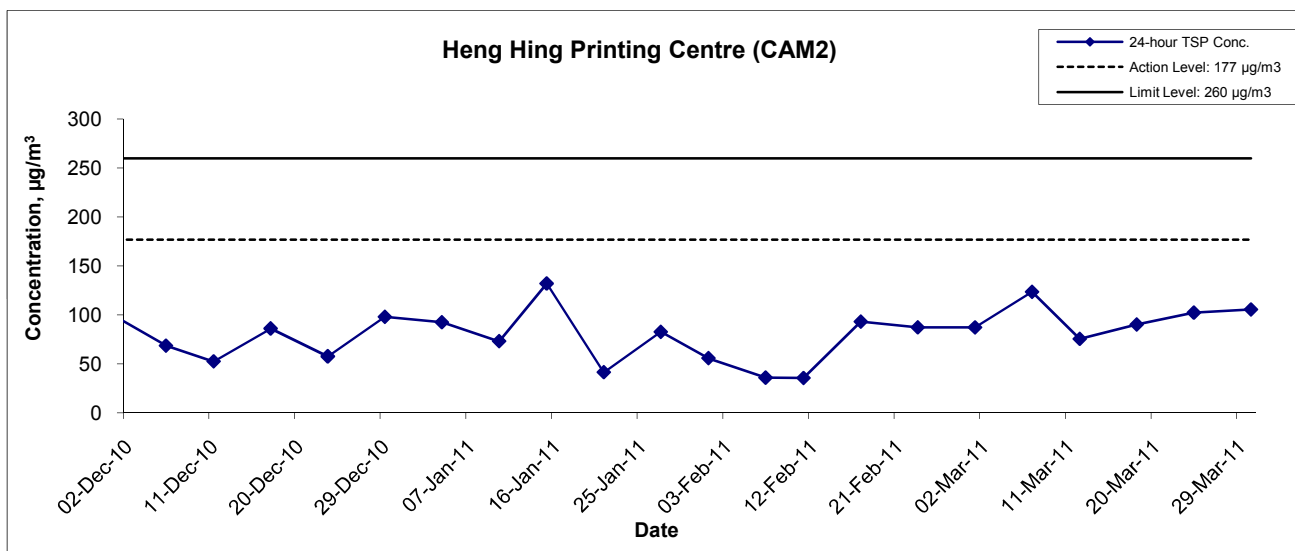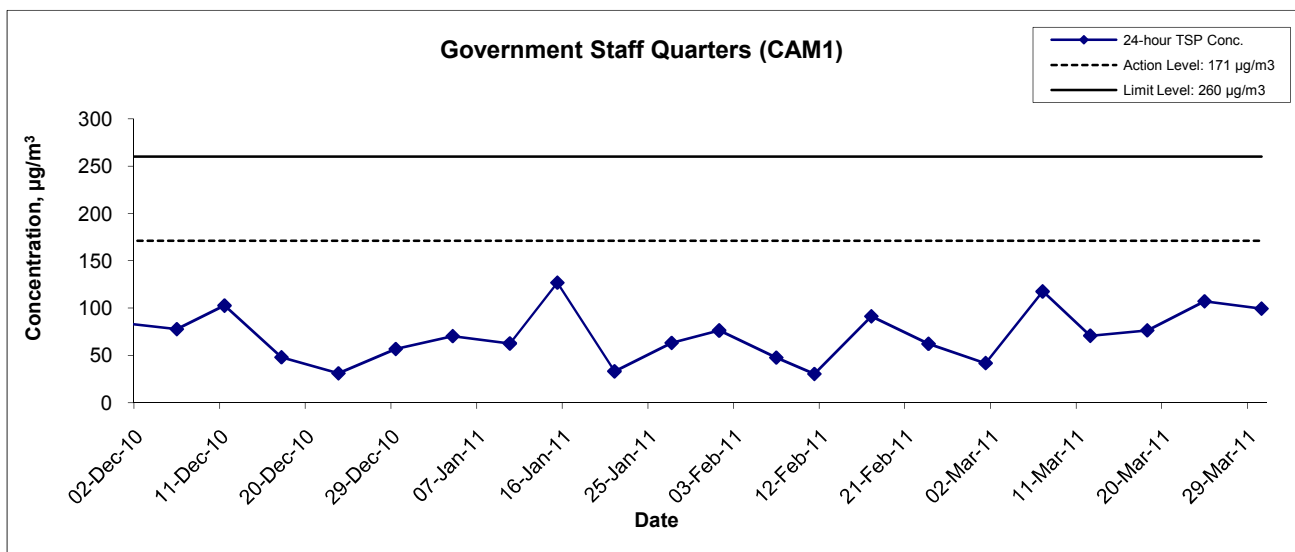

|                                                                                                                                                                           |       |             |                 |            |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------|-------------|-----------------|------------|
| Title<br>Contract No. DC/2009/09<br>Construction of Tai Po Sewage Treatment Works - Stage V Phase II B<br>Graphical Presentation of 24-hour TSP Impact Monitoring Results | Scale | Project No. | <b>CINOTECH</b> |            |
|                                                                                                                                                                           |       | N.T.S       |                 | MA0010     |
|                                                                                                                                                                           | Date  | Mar 11      |                 | Appendix E |

---

---

**APPENDIX F  
NOISE MONITORING RESULTS AND  
GRAPHICAL PRESENTATION**


---

---

## Appendix F - Noise Monitoring Results

| Location NM1 - Government Staff Quarters |       |         |                 |                 |                 |
|------------------------------------------|-------|---------|-----------------|-----------------|-----------------|
| Date                                     | Time  | Weather | dB (A) (30-min) |                 |                 |
|                                          |       |         | L <sub>eq</sub> | L <sub>10</sub> | L <sub>90</sub> |
| 1-Mar-11                                 | 13:15 | Sunny   | 63.7            | 65.5            | 59.9            |
| 10-Mar-11                                | 10:00 | Cloudy  | 64.9            | 66.3            | 62.1            |
| 15-Mar-11                                | 11:00 | Fine    | 63.9            | 66.0            | 57.7            |
| 22-Mar-11                                | 15:00 | Fine    | 62.1            | 64.3            | 58.2            |
| 29-Mar-11                                | 15:30 | Fine    | 62.8            | 64.6            | 58.3            |
|                                          |       | Average | 63.6            | 65.3            | 59.2            |
|                                          |       | Minimum | 62.1            | 64.3            | 57.7            |
|                                          |       | Maximum | 64.9            | 66.3            | 62.1            |

## Noise Levels

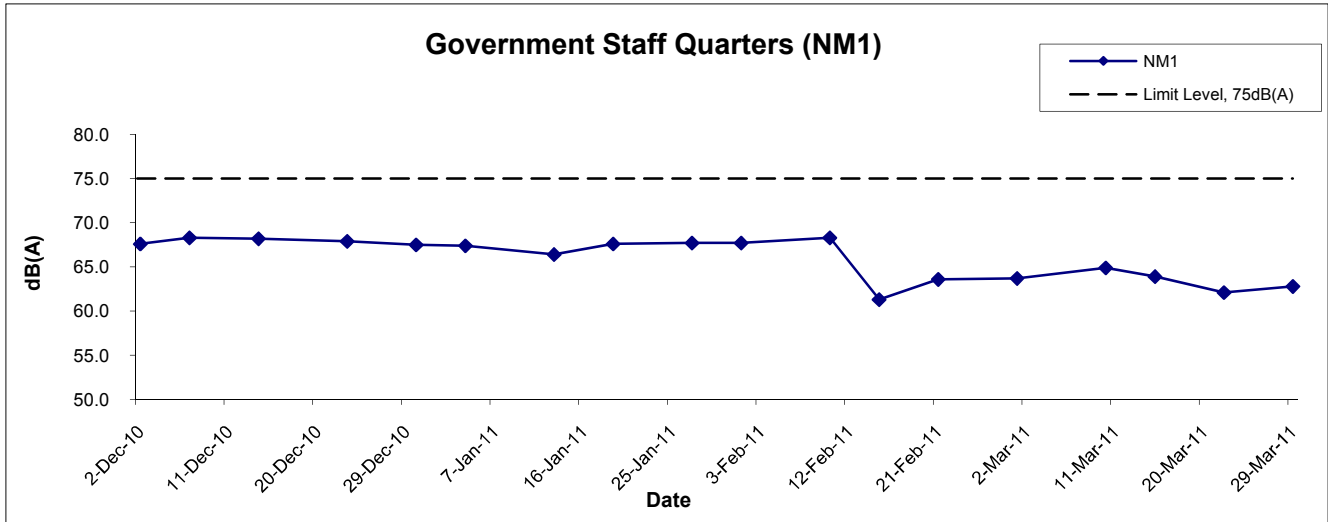

|                                                                                                                                                                           |                |                       |  |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|-----------------------|--|
| Title<br>Contract No. DC/2009/09<br>Construction of Tai Po Sewage Treatment Works - Stage V Phase II B<br>Graphical Presentation of Construction Noise Monitoring Results | Scale<br>N.T.S | Project No.<br>MA0010 |  |
|                                                                                                                                                                           | Date<br>Mar 11 | Appendix<br>F         |  |



---

---

**APPENDIX G  
RECORDS OF LANDFILL GAS  
MEASUREMENT BY THE  
CONTRACTOR**

---

---



**APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR**

| <b>Location</b> | <b>Date of Measurement</b> | <b>Sampling time</b> | <b>Balance gas (%)</b> | <b>Combustible Gas (Methane) (% LEL)</b> | <b>Carbon dioxide (%)</b> | <b>Oxygen (%)</b> |
|-----------------|----------------------------|----------------------|------------------------|------------------------------------------|---------------------------|-------------------|
| FC11B and FC12B | 1-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 1-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 2-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 2-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 3-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 3-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 4-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 4-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 5-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 5-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 7-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 7-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 8-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 8-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 9-Mar-11                   | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 9-Mar-11                   | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 10-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 10-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 11-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 11-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 12-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 12-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 14-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 14-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 15-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 15-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 16-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 16-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 17-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 17-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 18-Mar-11                  | 8:30 AM              | 79.1                   | 0                                        | 0                         | 20.9              |
|                 | 18-Mar-11                  | 1:30 PM              | 79.1                   | 0                                        | 0                         | 20.9              |
| 19-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 19-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 21-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 21-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 22-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 22-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 23-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 23-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 24-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 24-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 25-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 25-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 26-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 26-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 28-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 28-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 29-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 29-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 30-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 30-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 31-Mar-11       | 8:30 AM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |
| 31-Mar-11       | 1:30 PM                    | 79.1                 | 0                      | 0                                        | 20.9                      |                   |

**APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR**



| Location         | Date of Measurement | Sampling time | Balance gas (%) | Combustible Gas (Methane) (% LEL) | Carbon dioxide (%) | Oxygen (%) |
|------------------|---------------------|---------------|-----------------|-----------------------------------|--------------------|------------|
| Dewatering House | 1-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 1-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 2-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 2-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 3-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 3-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 4-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 4-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 5-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 5-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 7-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 7-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 8-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 8-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 9-Mar-11            | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 9-Mar-11            | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 10-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 10-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 11-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 11-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 12-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 12-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 14-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 14-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 15-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 15-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 15-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 15-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 16-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 16-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 17-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 17-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 18-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 18-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 19-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 19-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 21-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 21-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 22-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 22-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 22-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 22-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 23-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 23-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 24-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 24-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 25-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 25-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 26-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 26-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 28-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 28-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 29-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 29-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 30-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 30-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 31-Mar-11           | 8:15 AM       | 79.1            | 0                                 | 0                  | 20.9       |
|                  | 31-Mar-11           | 1:15 PM       | 79.1            | 0                                 | 0                  | 20.9       |

### Balance Gas

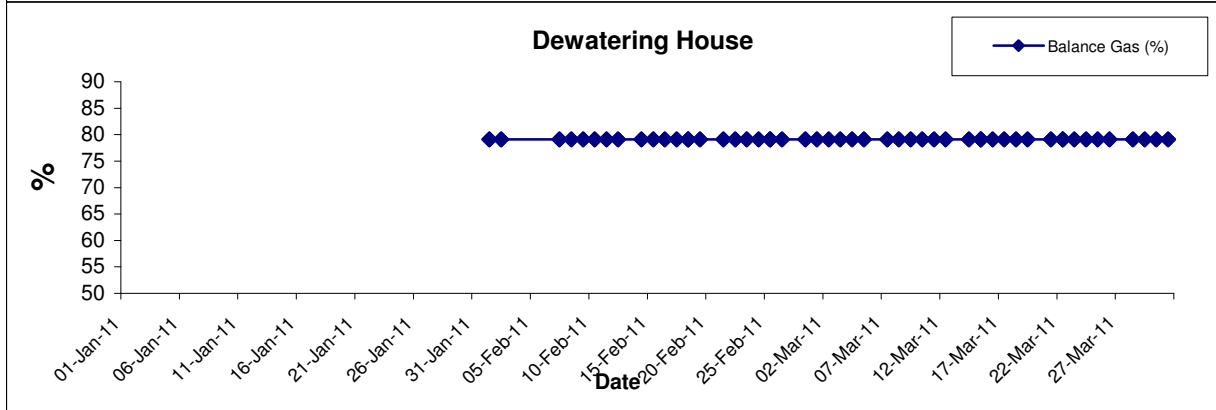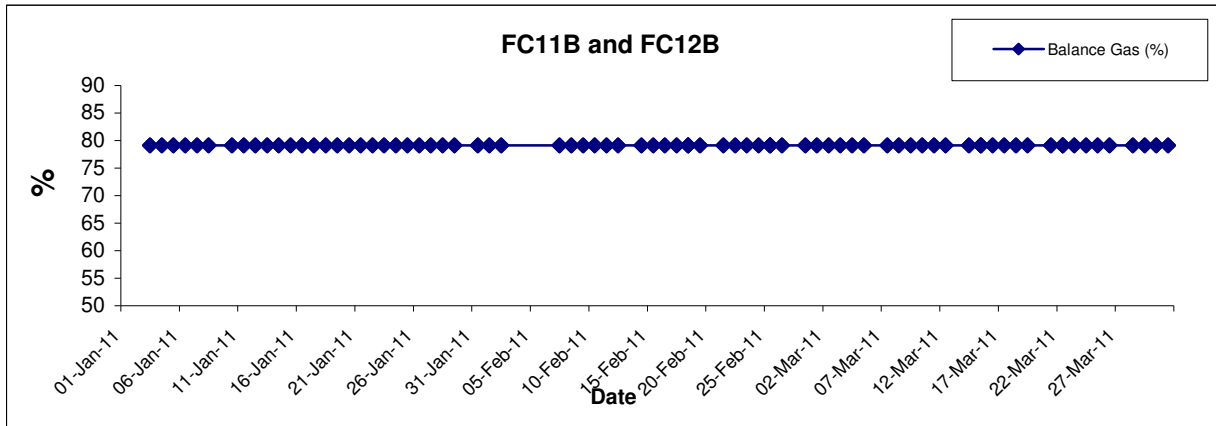



|                                                                                                                                                                     |                |                       |                 |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|-----------------------|-----------------|
| Title<br>Contract No. DC/2009/09<br>Construction of Tai Po Sewage Treatment Works - Stage V<br>Phase II B<br><br>Graphical Presentation of Landfill Gas Measurement | Scale<br>N.T.S | Project<br>No. MA0010 | <b>CINOTECH</b> |
|                                                                                                                                                                     | Date<br>Mar 11 | Appendix<br>G         |                 |

### Combustible Gas (Methane)

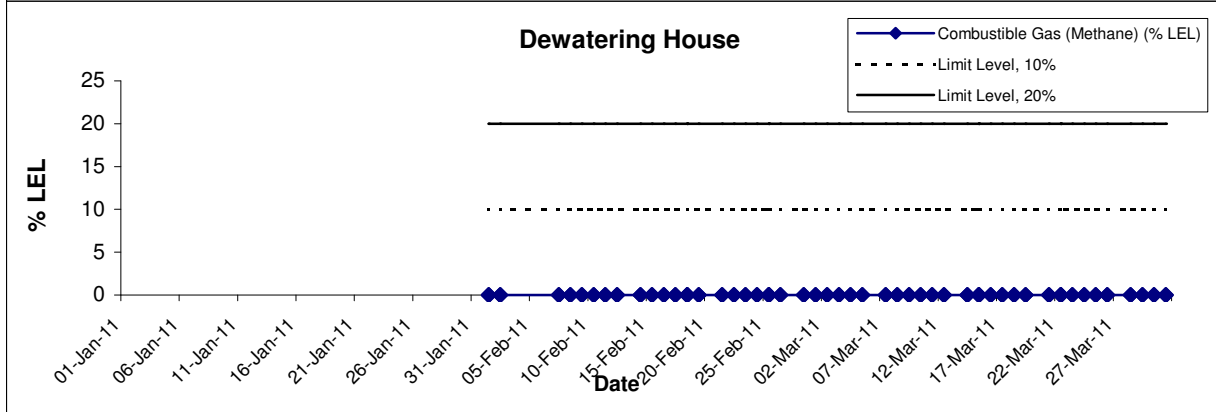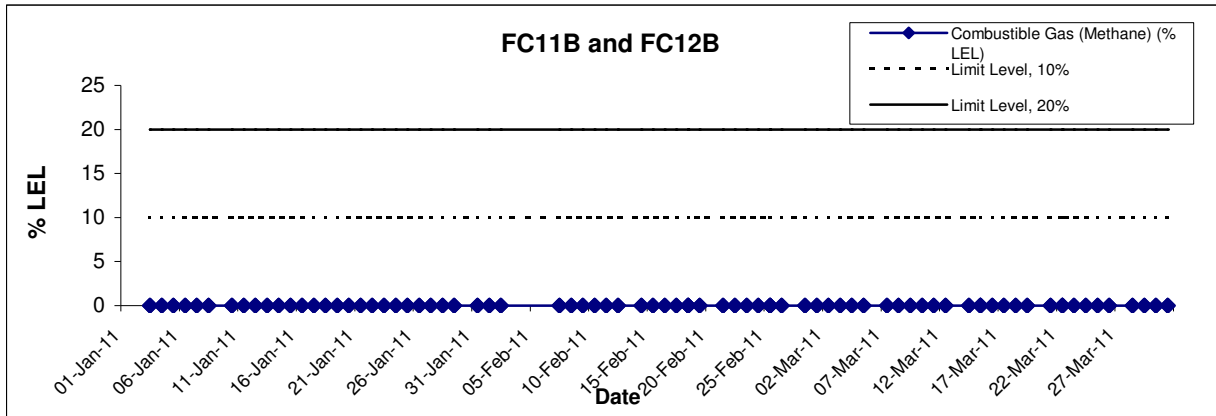



|                                                                                                                                                                 |                |                       |                 |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|-----------------------|-----------------|
| Title<br>Contract No. DC/2009/09<br>Construction of Tai Po Sewage Treatment Works - Stage V<br>Phase II B<br>Graphical Presentation of Landfill Gas Measurement | Scale<br>N.T.S | Project<br>No. MA0010 | <b>CINOTECH</b> |
|                                                                                                                                                                 | Date<br>Mar 11 | Appendix<br>G         |                 |

### Carbon Dioxide

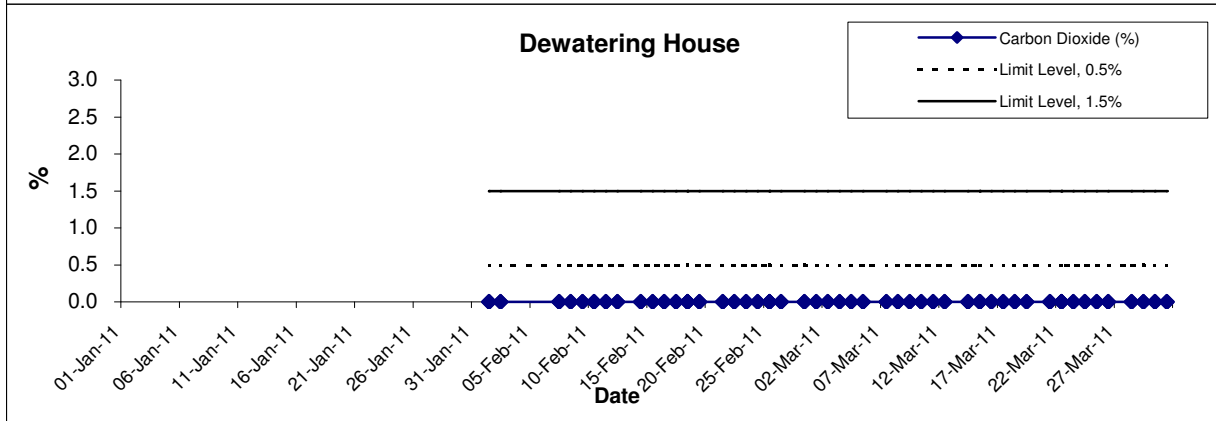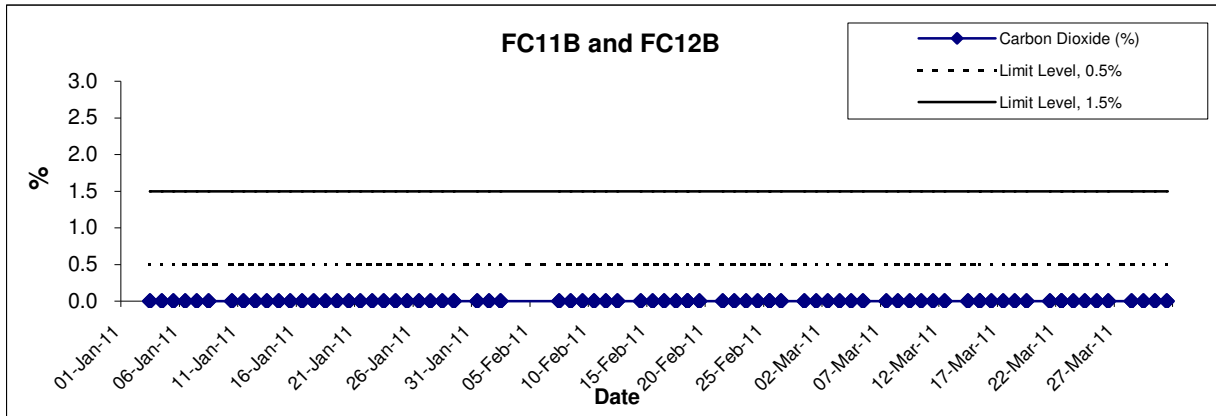

|                                                                                                                                                                 |        |          |  |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|----------|--|
| Title<br>Contract No. DC/2009/09<br>Construction of Tai Po Sewage Treatment Works - Stage V<br>Phase II B<br>Graphical Presentation of Landfill Gas Measurement | Scale  | Project  |  |
|                                                                                                                                                                 |        | N.T.S    |  |
| Date                                                                                                                                                            | Mar 11 | Appendix |  |

## Oxygen

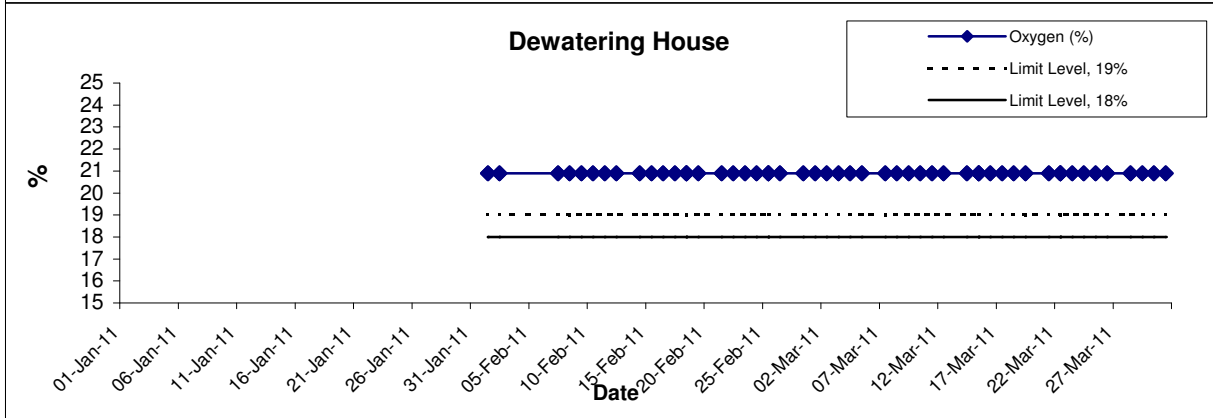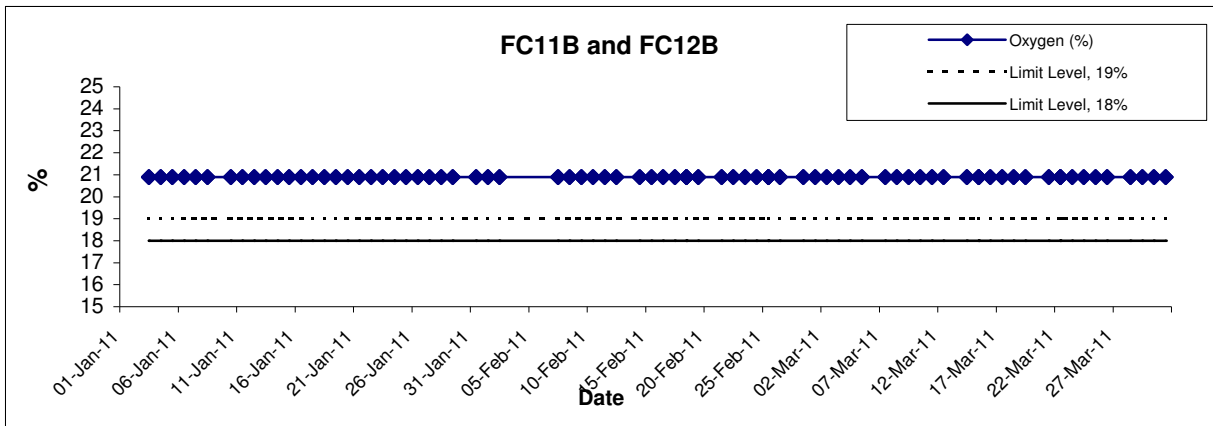

|                                                                                                                                                                 |        |            |          |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|------------|----------|
| Title<br>Contract No. DC/2009/09<br>Construction of Tai Po Sewage Treatment Works - Stage V<br>Phase II B<br>Graphical Presentation of Landfill Gas Measurement | Scale  | Project    | CINOTECH |
|                                                                                                                                                                 | N.T.S  | No. MA0010 |          |
|                                                                                                                                                                 | Date   | Appendix   |          |
|                                                                                                                                                                 | Mar 11 | G          |          |

---

---

**APPENDIX H**  
**SUMMARY OF EXCEEDANCE**

---

---



## **APPENIDX H – SUMMARY OF EXCEEDANCE**

**Reporting Month:** March 2011

- a) Exceedance Report for 1-hr TSP (NIL)*
- b) Exceedance Report for 24-hr TSP (NIL)*
- c) Exceedance Report for Construction Noise (NIL)*
- d) Exceedance Report for Landfill Gas (NIL)*

---

---

**APPENDIX I  
SITE AUDIT SUMMARY**

---

---



Record Summary of Environmental Site Inspection

Inspection Information

|                            |                                       |
|----------------------------|---------------------------------------|
| Checklist Reference Number | 110303                                |
| Date                       | 3 <sup>rd</sup> March 2011 (Thursday) |
| Time                       | 10:00-11:15                           |

| Ref. No. | Non-Compliance  | Related Item No. |
|----------|-----------------|------------------|
| -        | None identified | -                |

| Ref. No.   | Remarks/Observations                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Related Item No. |
|------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| 110303-R01 | <p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The stagnant water should be cleared regularly at A-Tank. The Contractor was reminded to reinforce the drainage system.</li> </ul> | B12              |
| 110303-R02 | <ul style="list-style-type: none"> <li>The Contractor was reminded to ensure the drainage system can be functioned properly, to avoid silty water directing to water channel.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.110224), all environmental deficiencies were improved/ rectified by the Contractor except item 110224-R02. Follow-up action is needed and remarked as 110303-R01.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | B1               |

|             | Name               | Signature                                                                           | Date         |
|-------------|--------------------|-------------------------------------------------------------------------------------|--------------|
| Recorded by | TY Yeung           |  | 3 March 2011 |
| Checked by  | Dr. Priscilla Choy |  | 3 March 2011 |



Record Summary of Environmental Site Inspection

Inspection Information

|                            |                                      |
|----------------------------|--------------------------------------|
| Checklist Reference Number | 110311                               |
| Date                       | 11 <sup>th</sup> March 2011 (Friday) |
| Time                       | 15:00-16:00                          |

| Ref. No. | Non-Compliance  | Related Item No. |
|----------|-----------------|------------------|
| -        | None identified | -                |

| Ref. No.   | Remarks/Observations                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | Related Item No. |
|------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| 110311-O01 | <p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>The drainage system was observed functioning improperly at FC11B&amp;12B. The Contractor was reminded to rectify the mitigation.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> | B1               |
| 110311-R02 | <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The Contractor was reminded to reinforce the bunding area, to avoid the wastewater directing to the road at outside site office.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.110303), all environmental deficiencies were improved/ rectified by the Contractor except item 110303-R02. Follow-up action is needed and remarked as 110311-O01.</p>                                                                                                                                                                                                                                                                                           | B14vi.           |

|             | Name               | Signature                                                                           | Date          |
|-------------|--------------------|-------------------------------------------------------------------------------------|---------------|
| Recorded by | TY Yeung           |  | 11 March 2011 |
| Checked by  | Dr. Priscilla Choy |  | 11 March 2011 |



Record Summary of Environmental Site Inspection

Inspection Information

|                            |                                        |
|----------------------------|----------------------------------------|
| Checklist Reference Number | 110317                                 |
| Date                       | 17 <sup>th</sup> March 2011 (Thursday) |
| Time                       | 10:00-11:15                            |

| Ref. No. | Non-Compliance  | Related Item No. |
|----------|-----------------|------------------|
| -        | None identified | -                |

| Ref. No.   | Remarks/Observations                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          | Related Item No. |
|------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| 110317-001 | <p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>The wheel washing bay was observed full of deposited mud at FC11B&amp;12B. The Contractor was reminded to clear the deposited mud as soon as possible.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> | B14iii.          |
| 110317-R02 | <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The general refuse within the rubbish bin should be cleared regularly at FC11B&amp;12B.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.110311), all environmental deficiencies were improved/ rectified by the Contractor.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                        | E1i.             |

|             | Name               | Signature                                                                           | Date          |
|-------------|--------------------|-------------------------------------------------------------------------------------|---------------|
| Recorded by | TY Yeung           |  | 17 March 2011 |
| Checked by  | Dr. Priscilla Choy |  | 17 March 2011 |



Record Summary of Environmental Site Inspection

Inspection Information

|                            |                                        |
|----------------------------|----------------------------------------|
| Checklist Reference Number | 110324                                 |
| Date                       | 24 <sup>th</sup> March 2011 (Thursday) |
| Time                       | 10:00-11:15                            |

| Ref. No. | Non-Compliance  | Related Item No. |
|----------|-----------------|------------------|
| -        | None identified | -                |

| Ref. No.   | Remarks/Observations                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             | Related Item No. |
|------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| 110324-R01 | <p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The general refuse should be cleared regularly, to avoid accumulation of waste at FC11B&amp;12B.</li> </ul> | E11.             |
| 110324-R02 | <ul style="list-style-type: none"> <li>The deposited mud at haul road should be cleared at FC11B&amp;12B.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.110317), all environmental deficiencies were improved/ rectified by the Contractor except item 110317-R02. Follow-up action is needed and remarked as 110324-R01.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | E6               |

|             | Name               | Signature                                                                           | Date          |
|-------------|--------------------|-------------------------------------------------------------------------------------|---------------|
| Recorded by | TY Yeung           |  | 24 March 2011 |
| Checked by  | Dr. Priscilla Choy |  | 24 March 2011 |



Record Summary of Environmental Site Inspection

Inspection Information

|                            |                                        |
|----------------------------|----------------------------------------|
| Checklist Reference Number | 110331                                 |
| Date                       | 31 <sup>st</sup> March 2011 (Thursday) |
| Time                       | 10:00-11:00                            |

| Ref. No. | Non-Compliance  | Related Item No. |
|----------|-----------------|------------------|
| -        | None identified | -                |

| Ref. No.                 | Remarks/Observations                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         | Related Item No. |
|--------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------|
| 110331-R01<br>110331-R02 | <p><b>Part B - Water Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part C - Air Quality</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part D - Noise</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part E - Waste / Chemical Management</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part F - Permit / Licenses</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p><b>Part G - Reminder</b></p> <ul style="list-style-type: none"> <li>The ponding water should be cleared regularly at A-Tank.</li> <li>The stagnant water within the sedimentation tank should be cleared at A-Tank.</li> </ul> <p><b>Others</b></p> <ul style="list-style-type: none"> <li>No environmental deficiency was identified during the site inspection.</li> </ul> <p>• Follow-up on the previous audit sessions (Ref. No.110324), all environmental deficiencies were improved/ rectified by the Contractor.</p> | B12<br>B12       |

|             | Name               | Signature                                                                           | Date          |
|-------------|--------------------|-------------------------------------------------------------------------------------|---------------|
| Recorded by | TY Yeung           |  | 31 March 2011 |
| Checked by  | Dr. Priscilla Choy |  | 31 March 2011 |

---

---

**APPENDIX J**  
**EVENT ACTION PLANS**

---

---



**APPENDIX J (1) – Event Action Plan for Air Quality Monitoring (Construction Phase)**

| EVENT                                             | ACTION                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                                                                                    |
|---------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                                                   | ET                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | IEC                                                                                                                                                                                                                                                                                                                                                | ER                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | CONTRACTOR                                                                                                                                                                                                                                                                                                                                                                                                         |
| <b>ACTION LEVEL</b>                               |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |                                                                                                                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                                                                                    |
| 1. Exceedance for one sample                      | <ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform IEC and ER;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily.</li> </ol>                                                                                                                                                                                                                                                                                                                                      | <ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>                                                                                                                                                                                                               | <ol style="list-style-type: none"> <li>Notify Contractor.</li> </ol>                                                                                                                                                                                                                                                                                                                                                                                                                      | <ol style="list-style-type: none"> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>                                                                                                                                                                                                                                                                                |
| 2. Exceedance for two or more consecutive samples | <ol style="list-style-type: none"> <li>Identify source;</li> <li>Inform IC(E) and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>                                                                                                                  | <ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol> | <ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Ensure remedial measures properly implemented.</li> </ol>                                                                                                                                                                                                                                                                                                                       | <ol style="list-style-type: none"> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>                                                                                                                                                                                         |
| <b>LIMIT LEVEL</b>                                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |                                                                                                                                                                                                                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                                                                                    |
| 1. Exceedance for one sample                      | <ol style="list-style-type: none"> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform Contractor, IEC, ER, and EPD;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ol>                                                                                                                                                                                                   | <ol style="list-style-type: none"> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol> | <ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>                                                                                                                                                                                                                                                                                           | <ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals; 4. Amend proposal if appropriate.</li> </ol>                                                                                                                                   |
| 2. Exceedance for two or more consecutive samples | <ol style="list-style-type: none"> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol> | <ol style="list-style-type: none"> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>                              | <ol style="list-style-type: none"> <li>Confirm receipt of notification of exceedance in writing;</li> <li>Notify Contractor;</li> <li>In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol> | <ol style="list-style-type: none"> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within three working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol> |

**APPENDIX J (2) – Event Action Plan for Construction Noise Monitoring (Construction Phase)**

| EVENT                      | ACTION                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |                                                                                                                                                                                                                                                                                                                                |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |                                                                                                                                                                                                                                                                                                                                                                                                                               |
|----------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                            | ET                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 | IEC                                                                                                                                                                                                                                                                                                                            | ER                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | CONTRACTOR                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b><i>ACTION LEVEL</i></b> | <ol style="list-style-type: none"> <li>1. Notify IEC and Contractor;</li> <li>2. Carry out investigation;</li> <li>3. Report the results of investigation to the IEC, ER and Contractor;</li> <li>4. Discuss with the Contractor and formulate remedial measures;</li> <li>5. Increase monitoring frequency to check mitigation effectiveness.</li> </ol>                                                                                                                                                                                                                                                          | <ol style="list-style-type: none"> <li>1. Review the analyzed results submitted by the ET;</li> <li>2. Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol>                                                        | <ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analyzed noise problem;</li> <li>4. Ensure remedial measures are properly implemented.</li> </ol>                                                                                                                                                                            | <ol style="list-style-type: none"> <li>1. Submit noise mitigation proposals to IEC;</li> <li>2. Implement noise mitigation proposals.</li> </ol>                                                                                                                                                                                                                                                                              |
| <b><i>LIMIT LEVEL</i></b>  | <ol style="list-style-type: none"> <li>1. Identify source;</li> <li>2. Inform IEC, ER, EPD and Contractor;</li> <li>3. Repeat measurements to confirm findings;</li> <li>4. Increase monitoring frequency;</li> <li>5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>6. Inform IEC, ER and EPD the causes and actions taken for the exceedances;</li> <li>7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>8. If exceedance stops, cease additional monitoring.</li> </ol> | <ol style="list-style-type: none"> <li>1. Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>3. Supervise the implementation of remedial measures.</li> </ol> | <ol style="list-style-type: none"> <li>1. Confirm receipt of notification of failure in writing;</li> <li>2. Notify Contractor;</li> <li>3. Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>4. Ensure remedial measures properly implemented;</li> <li>5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol> | <ol style="list-style-type: none"> <li>1. Take immediate action to avoid further exceedance;</li> <li>2. Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>3. Implement the agreed proposals;</li> <li>4. Resubmit proposals if problem still not under control;</li> <li>5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol> |

**APPENDIX J (3) – Event Action Plan for Landfill Gas Monitoring (Construction Phase)**

| <b>Parameter</b> | <b>Limit Level</b>              | <b>Action Required</b>                                                                                         |
|------------------|---------------------------------|----------------------------------------------------------------------------------------------------------------|
| Oxygen           | <19%                            | Ventilate to restore oxygen to >19%                                                                            |
|                  | <18%                            | Stop works;<br>Evacuate personnel / prohibit entry;<br>Increase ventilation to restore oxygen to > 19%         |
| Methane          | >10% LEL (i.e. >0.5% by volume) | Post “no smoking signs;<br>Prohibit hot works;<br>Ventilate to restore methane to <10% LEL                     |
|                  | >20% LEL (i.e. >1% by volume)   | Stop works;<br>Evacuate personnel / prohibit entry;<br>Increase ventilation to restore methane to <10% LEL     |
| Carbon Dioxide   | >0.5%                           | Ventilate to restore carbon dioxide to <0.5%                                                                   |
|                  | >1.5%                           | Stop works;<br>Evacuate personnel / prohibit entry;<br>Increase ventilation to restore carbon dioxide to <0.5% |

---

---

**APPENDIX K  
UPDATED ENVIRONMENTAL  
MITIGATION IMPLEMENTATION  
SCHEDULE**

---

---

**APPENDIX K – Updated Environmental Mitigation Implementation Schedule  
(During Construction Phase)**

| Type of Impact       | Recommended Mitigation Measures                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        | Status |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|
| <b>Air Quality</b>   | Dust mitigation measures stipulated in <i>the Air Pollution Control (Construction Dust) Regulation</i> shall be incorporated to control dust emission. Notice shall be given to authority prior to commencing of work                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | √      |
| <b>Noise</b>         | Use of quiet PME                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | N/A    |
|                      | <p>Good Site Practice</p> <ul style="list-style-type: none"> <li>• Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program;</li> <li>• Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program;</li> <li>• Mobile plant, if any, should be sited as far from NSRs as possible;</li> <li>• Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>• Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and</li> <li>• Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities.</li> </ul>                                                                  | √      |
| <b>Water Quality</b> | The practices outlined in ProPECC PN 1/94 Construction Site Drainage should be adopted to minimize the potential water quality impacts from construction site runoff and various construction activities. The recommendation to install perimeter drains to collect site runoff and to properly treat the runoff by settlement tank/treatment system shall apply to all sites including those for mainlaying works. Minimum distances of 100 m should be maintained between the discharge points of construction site runoff and the existing WSD saltwater intake at Tai Po.                                                                                                                                                                                                                                                                                                                                                                                                                                          | √      |
|                      | A discharge licence needs to be applied from EPD for discharging effluent from the construction site. The discharge quality is required to meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies with all the standards listed in the TM. Reuse and recycling of the treated effluent can minimize water consumption and reduce the effluent discharge volume. The beneficial uses of the treated effluent may include dust suppression, wheel washing and general cleaning. Monitoring of the discharge quality of treated effluent should be part of the Environmental Monitoring and Audit (EM&A) programme. Detailed effluent sampling programme for water quality control during construction phase should be submitted to EPD, AFCD and WSD for approval prior to commencement of the construction works.                                                                                                | √      |
|                      | The construction programme should be properly planned to minimize soil excavation, if any, in rainy seasons. This prevents soil erosion from exposed soil surfaces. Any exposed soil surfaces should also be properly protected to minimize dust emission. In areas where a large amount of exposed soils exist, earth bunds or sand bags should be provided. Exposed stockpiles should be covered with tarpaulin or impervious sheets at all time. The stockpiles of materials should be placed in the locations away from any stream courses so as to avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted and protected by permanent work. It is suggested that haul roads should be paved with concrete and the temporary access roads are protected using crushed stone or gravel, wherever practicable. Wheel washing facilities should be provided at all site exits to ensure that earth, mud and debris would not be carried out of the works areas by vehicles. | √      |
|                      | Good site practices should be adopted to clean the rubbish and litter on the construction sites so as to prevent the rubbish and litter from dropping into the nearby environment. It is recommended to clean the construction sites on a regular basis.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | √      |

| Type of Impact | Recommended Mitigation Measures                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | Status |
|----------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|
|                | It is recommended to provide sufficient chemical toilets in the works areas. The toilet facilities should not be less than 30 m from any watercourse. A licensed waste collector should be deployed to clean the chemical toilets on a regular basis. The construction workers can also make use of the existing toilet facilities within the TPSTW as necessary.                                                                                                                                                                                                                                                                                                                                                                                                                                                   | √      |
|                | Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the project. Implementation of environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site.                                                                                                                                                                                                                                                                                                                                                                                                                         | √      |
|                | It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.                                                                                                                                                                                                                                                                                                                                                                                                                                                                    | √      |
|                | Any service shop and minor maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken with the areas appropriately equipped to control these discharges.                                                                                                                                                                                                                                                                                                                                                                                                                                                      | √      |
|                | <p>Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows:</p> <ul style="list-style-type: none"> <li>• Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport</li> <li>• Chemical waste containers should be suitably labelled to notify and warn the personnel who are handling the wastes to avoid accidents.</li> <li>• Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area.</li> </ul> | √      |
|                | Marine water quality monitoring should be carried out under emergency condition or during maintenance of the THEES tunnel to verify the findings of the water quality modelling. It is recommended that the maintenance of the THEES tunnel, if unavoidable, should be conducted during winter season or low flow periods and to avoid the “blooming” season of algae (normally from April to June) if practicable. Details of the monitoring requirements are specified in the EM&A Manual.                                                                                                                                                                                                                                                                                                                        | N/A    |

| Type of Impact          | Recommended Mitigation Measures                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            | Status |
|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|
| <b>Waste Management</b> | <p>Good site practices during the construction activities include:</p> <ul style="list-style-type: none"> <li>• Nomination of approved personnel, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site.</li> <li>• Training of site personnel in proper waste management and chemical waste handling procedures.</li> <li>• Provision of sufficient waste disposal points and regular collection for disposal.</li> <li>• Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers.</li> <li>• Separation of chemical wastes for special handling and appropriate treatment at the Chemical Waste Treatment Facility.</li> <li>• Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors.</li> <li>• A Waste Management Plan shall be prepared and this WMP shall be submitted to the Engineer for approval. One may make reference to ETWB TCW No. 15/2003 for details.</li> <li>• In order to monitor the disposal of C&amp;D materials at landfills and public filling areas, and to control fly tipping, a trip-ticket system shall be included as one of the contractual requirements and implemented by an Environmental Team undertaking the Environmental Monitoring and Audit work. One may make reference to WBTC No. 21/2002 for details.</li> <li>• A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) shall be proposed.</li> </ul> | √      |
|                         | <p>Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> <li>• Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.</li> <li>• To encourage collection of aluminum cans by individual collectors, separate labelled bins shall be provided to segregate this waste from other general refuse generated by the work force.</li> <li>• Any unused chemicals or those with remaining functional capacity shall be recycled.</li> <li>• Maximize the use of reusable steel formwork to reduce the amount of C&amp;D material.</li> <li>• Prior to disposal of C&amp;D waste, it is recommended that wood, steel and other metals shall be separated for re-use and / or recycling to minimize the quantity of waste to be disposed of to landfill.</li> <li>• Proper storage and site practices to minimize the potential for damage or contamination of construction materials.</li> <li>• Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste.</li> <li>• Minimize over ordering of concrete, mortars and cement grout by doing careful check before ordering</li> </ul>                                                                                                                                                                                                                                             | √      |
|                         | <p><i>General Refuse</i></p> <p>General refuse shall be stored in enclosed bins or compaction units separate from C&amp;D material. A reputable waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&amp;D material. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       | √      |
|                         | <p><i>Construction &amp; Demolition (C&amp;D) Material</i></p> <p>C&amp;D material generated from the site formation and demolition works shall be sorted on-site into inert C&amp;D material (i.e. public fill) and C&amp;D waste. In order to minimise the impact resulting from collection and transportation of C&amp;D material for off-site disposal, the excavated material comprising fill material shall be reused on-site as backfilling material as far as practicable. C&amp;D waste, such as wood, plastic, steel and other metals shall be reused or recycled and, as a last resort, disposed of to landfill. A suitable area shall be designated within the site for temporary stockpiling of C&amp;D material and to facilitate the sorting process.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   | √      |

| Type of Impact             | Recommended Mitigation Measures                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                | Status |
|----------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------|
|                            | <p><i>Bentonite Slurry</i></p> <p>Bentonite slurries used in construction works should be reconditioned and reused wherever practicable. Residual used bentonite slurry should be disposed of from the site as soon as possible. The Contractor should explore alternative disposal outlets for the residual used bentonite slurry and disposal at landfill should be the last resort.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | N/A    |
| <b>Landfill Gas Hazard</b> | <p>All personnel who work on the site and all visitors to the site should be aware of the possibility of ignition of gas in the vicinity of excavations. Safety notices should be displayed at prominent position around the site. Adequate fire extinguisher equipment and fire resistant clothing should be made available on site.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | √      |
|                            | <p>Service runs within the consultation zone should be designated as “special routes” and utilities companies should be informed of this and should implement precautionary measures.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      | √      |
|                            | <p>Precautionary measures to minimize landfill gas hazard during excavation:</p> <ul style="list-style-type: none"> <li>• No smoking or burning shall be allowed</li> <li>• No worker shall work alone at any time in the confined space or any excavation trenches</li> <li>• Construction equipment shall be equipped with a vertical exhaust at least 0.6 m above ground level and /or with a park arrestors</li> <li>• Electrical motors and electrical extension cords shall be explosive-proof or intrinsically safe</li> <li>• Permit to Work procedures to be adopted for welding, flame cutting or other hot works in trenches or confined spaces</li> <li>• Forced ventilation if working in a trench deeper than 1 m</li> <li>• Close all valves immediately after piping assembly or conduiting construction. For the large diameter pipes, pipe end shall be capped on one side. Forced ventilation shall also be provided before commissioning of the pipeline and staff entering and working in it</li> <li>• Routine monitoring shall be conducted in all excavations to ensure the works area to be free of landfill gas before any man enters the area.</li> <li>• Landfill gas precautionary measures involved with excavation and piping works shall be included in the Safety Plan</li> <li>• Monitoring shall be conducted at the cracks on the ground floor during ground-works construction</li> </ul> | √      |
|                            | <p>Where there are any temporary site offices, or any other buildings which have enclosed spaces with the capacity to accumulate landfill gas, then they should either:</p> <ul style="list-style-type: none"> <li>• be located on an area which has been proven to be free of landfill gas (by survey with portable gas detectors) and monitored manually by the Safety Officer or an approved wand appropriately qualified person to ensure that hazardous concentration of landfill gas does not occur; or</li> <li>• be raised clear of the ground. If buildings are raised clear of the ground, a minimum, clear separation (as measured from the highest point on the ground surface to the underside of lowest floor joist) should be 500mm</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  | √      |

**Note:**

- √ – Compliance of mitigation measures  
X – Non-compliance of mitigation measures  
N/A – Not applicable



---

---

**APPENDIX L  
WASTE GENERATION IN THE  
REPORTING MONTH**

---

---

**APPENDIX L – WASTE GENERATION IN THE REPORTING MONTH**

**Monthly Summary Waste Flow Table March 2011 (Year)**

| Month     | Actual Quantities of Inert C&D Materials Generated Monthly |                              |                          |                          |                          |                          | Actual Quantities of C&D Wastes Generated Monthly |                            |                      |                |                             |
|-----------|------------------------------------------------------------|------------------------------|--------------------------|--------------------------|--------------------------|--------------------------|---------------------------------------------------|----------------------------|----------------------|----------------|-----------------------------|
|           | Total Quantity Generated                                   | Broken Concrete (see Note 3) | Reused in the Contract   | Reused in other Projects | Disposed as Public Fill  | Imported Fill            | Metals                                            | Paper/ cardboard packaging | Plastic (see Note 2) | Chemical Waste | Others, e.g. general refuse |
|           | (in '000m <sup>3</sup> )                                   | (in '000m <sup>3</sup> )     | (in '000m <sup>3</sup> ) | (in '000m <sup>3</sup> ) | (in '000m <sup>3</sup> ) | (in '000m <sup>3</sup> ) | (in '000kg)                                       | (in '000kg)                | (in '000kg)          | (in '000kg)    | (in '000m <sup>3</sup> )    |
| Jan       | 5.1                                                        | 0                            | 0                        | 0                        | 5.1                      | 0                        | 1.4                                               | 0                          | 0                    | 0              | 0.01                        |
| Feb       | 2.7                                                        | 0                            | 0                        | 0.17                     | 2.7                      | 0                        | 1.3                                               | 0                          | 0                    | 0              | 0.01                        |
| Mar       | 2.7                                                        | 0                            | 0                        | 3.5                      | 2.7                      | 0                        | 1.5                                               | 0                          | 0                    | 0              | 0.01                        |
| Apr       |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| May       |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| June      |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Sub-total | 10.5                                                       | 0                            | 0                        | 3.67                     | 10.5                     | 0                        | 4.2                                               | 0                          | 0                    | 0              | 0.03                        |
| July      |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Aug       |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Sept      |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Oct       |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Nov       |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Dec       |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |
| Total     |                                                            |                              |                          |                          |                          |                          |                                                   |                            |                      |                |                             |

- Notes: (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.  
 (2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.  
 (3) Broken concrete for recycling into aggregates.

---

---

**APPENDIX M  
COMPLAINT LOG**

---

---

**APPENDIX M – COMPLAINT LOG****Reporting Month:** March 2011

| <b>Log Ref.</b> | <b>Location</b> | <b>Received Date</b> | <b>Details of Complaint</b> | <b>Investigation/Mitigation Action</b> | <b>Status</b> |
|-----------------|-----------------|----------------------|-----------------------------|----------------------------------------|---------------|
| N/A             | N/A             | N/A                  | N/A                         | N/A                                    | N/A           |

**Remarks:** No environmental complaint was received in the reporting month.

---

---

**APPENDIX N**  
**CONSTRUCTION PROGRAMME**

---

---



| Act ID                                        | Description                                  | Orig Dur | Early Start | Early Finish | Total Float | 2010                                         |     |     |     |     |     |     |     |     |     |     |     | 2011 |     |     |     |     |     |     |     |     |     |     |     | 2012 |     |     |     |     |     |     |     |     |     |     |     | 2013 |     |     |     |     |     |     |     |     |     |     |  |
|-----------------------------------------------|----------------------------------------------|----------|-------------|--------------|-------------|----------------------------------------------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|------|-----|-----|-----|-----|-----|-----|-----|-----|-----|-----|--|
|                                               |                                              |          |             |              |             | FEB                                          | MAR | APR | MAY | JUN | JUL | AUG | SEP | OCT | NOV | DEC | JAN | FEB  | MAR | APR | MAY | JUN | JUL | AUG | SEP | OCT | NOV | DEC | JAN | FEB  | MAR | APR | MAY | JUN | JUL | AUG | SEP | OCT | NOV | DEC | JAN | FEB  | MAR | APR | MAY | JUN | JUL | AUG | SEP | OCT | NOV | DEC |  |
| <b>General</b>                                |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| Project Key Dates                             |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1000                                          | Possession of Site                           | 0        |             | 28JAN10      | 1155d       | Possession of Site                           |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10000                                         | Completion of Section I of Works (365d)      | 0        |             | 28JAN11      | 790d        | ◆ Completion of Section I of Works (365d)    |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 20000                                         | Completion of Section II of Works (460d)     | 0        |             | 01JUN12      | 330d        | ◆ Completion of Section II of Works (460d)   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 30000                                         | Completion of Section III of Works (670d)    | 0        |             | 28DEC11      | 486d        | ◆ Completion of Section III of Works (670d)  |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 40000                                         | Completion of Section IV of Works (365d)     | 0        |             | 28JAN11      | 820d        | ◆ Completion of Section IV of Works (365d)   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 50000                                         | Completion of Section V of Works (1185d)     | 0        |             | 27APR13      | 0           | ◆ Completion of Section V of Works           |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| <b>Preliminary</b>                            |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1010                                          | Site Clearance                               | 30       | 29JAN10     | 27FEB10      | 0           | Site Clearance                               |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1020                                          | Contractor Site Office Set-up                | 60       | 28FEB10     | 28APR10      | 84d         | Contractor Site Office Set-up                |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1030                                          | Engineer's Accommodation                     | 60       | 28FEB10     | 28APR10      | 1035d       | Engineer's Accommodation                     |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1040                                          | Initial Survey                               | 60       | 29JAN10     | 29MAR10      | 25d         | Initial Survey                               |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1050                                          | Condition Survey                             | 60       | 29JAN10     | 29MAR10      | 2d          | Condition Survey                             |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 1060                                          | Environmental Baseline Monitoring            | 14       | 30MAR10     | 12APR10      | 1111d       | Environmental Baseline Monitoring            |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| <b>Submission for Approval</b>                |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2010                                          | Engineer's Green Roof                        | 60       | 29APR10     | 27JUN10      | 1035d       | Engineer's Green Roof                        |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2020                                          | Excavation and Lateral Support (ELS)         | 30       | 29APR10     | 28MAY10      | 84d         | Excavation and Lateral Support (ELS)         |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2030                                          | Project Signboard                            | 30       | 29APR10     | 28MAY10      | 1065d       | Project Signboard                            |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2040                                          | Pile Load Test Set-up                        | 30       | 30MAR10     | 28APR10      | 2d          | Pile Load Test Set-up                        |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2050                                          | Falsewk & Fwk for Pile Cap                   | 30       | 29MAY10     | 27JUN10      | 90d         | Falsewk & Fwk for Pile Cap                   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2060                                          | Falsewk & Fwk for Wall Structure             | 30       | 28JUN10     | 27JUL10      | 90d         | Falsewk & Fwk for Wall Structure             |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2070                                          | Falsewk & Fwk for Top Slab                   | 30       | 28JUL10     | 26AUG10      | 840d        | Falsewk & Fwk for Top Slab                   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2080                                          | Multi-part Cover                             | 45       | 27AUG10     | 10OCT10      | 840d        | Multi-part Cover                             |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2090                                          | FRP Handrail, Stair & Floor                  | 45       | 11OCT10     | 24NOV10      | 840d        | FRP Handrail, Stair & Floor                  |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2100                                          | FRP Cover                                    | 30       | 11OCT10     | 09NOV10      | 900d        | FRP Cover                                    |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2110                                          | Aluminium Flooring                           | 45       | 25NOV10     | 08JAN11      | 840d        | Aluminium Flooring                           |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2120                                          | Green Roof System at Sludge Dewatering House | 60       | 29APR10     | 27JUN10      | 310d        | Green Roof System at Sludge Dewatering House |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 2130                                          | Green Roof System at Transformer House       | 60       | 29APR10     | 27JUN10      | 1035d       | Green Roof System at Transformer House       |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| <b>Material Fabrication &amp; Delivery</b>    |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 3010                                          | Casing for Mini-pile                         | 55       | 29APR10     | 22JUN10      | 173d        | Casing for Mini-pile                         |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 3020                                          | Casing for Socketted H-pile                  | 55       | 28FEB10     | 23APR10      | 0           | Casing for Socketted H-pile                  |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 3030                                          | Steel Member for Socketted H-pile            | 55       | 28FEB10     | 23APR10      | 0           | Steel Member for Socketted H-pile            |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 3040                                          | DI Water Pipe Puddle & Tee                   | 180      | 29JAN10     | 27JUL10      | 90d         | DI Water Pipe Puddle & Tee                   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 3050                                          | DI Water Pipeline                            | 180      | 29JAN10     | 27JUL10      | 1005d       | DI Water Pipeline                            |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 3060                                          | Steel Member for Shelter                     | 60       | 29JAN10     | 29MAR10      | 1125d       | Steel Member for Shelter                     |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| <b>Section I of Works</b>                     |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| <b>Drilling Works</b>                         |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10010                                         | Section I of Work                            | 365      | 29JAN10     | 28JAN11      | 0           | Section I of Work                            |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10100                                         | Pre-drilling Works (18 nos)                  | 45       | 10MAR10     | 23APR10      | 0           | Pre-drilling Works (18 nos)                  |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10110                                         | Preliminary Socketted H-pile                 | 7        | 24APR10     | 30APR10      | 0           | Preliminary Socketted H-pile                 |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10120                                         | Load Test for Preliminary Pile               | 14       | 01MAY10     | 14MAY10      | 0           | Load Test for Preliminary Pile               |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10130                                         | Socketted H-piling (56 nos)                  | 84       | 15MAY10     | 06AUG10      | 0           | Socketted H-piling (56 nos)                  |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10140                                         | Proof Drilling (4 nos)                       | 14       | 07AUG10     | 20AUG10      | 0           | Proof Drilling (4 nos)                       |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10150                                         | Load Test for Main Pile (1 no)               | 14       | 07AUG10     | 20AUG10      | 0           | Load Test for Main Pile (1 no)               |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 10160                                         | Removal of DN525 & DN900 conc. pipe          | 45       | 04JUL10     | 17AUG10      | 164d        | Removal of DN525 & DN900 conc. pipe          |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| <b>Final Classifier No. FC11B &amp; FC12B</b> |                                              |          |             |              |             |                                              |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11010                                         | Excavation for FC12B                         | 21       | 21AUG10     | 10SEP10      | 0           | Excavation for FC12B                         |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11020                                         | Pile Head Construction for FC12B             | 17       | 11SEP10     | 27SEP10      | 4d          | Pile Head Construction for FC12B             |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11025                                         | Base Slab of FC12B                           | 22       | 18OCT10     | 18OCT10      | 7d          | Base Slab of FC12B                           |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11030                                         | Structural Wall for FC12B                    | 35       | 19OCT10     | 22NOV10      | 7d          | Structural Wall for FC12B                    |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11040                                         | Watertightness Test for FC12B                | 20       | 23NOV10     | 12DEC10      | 7d          | Watertightness Test for FC12B                |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11050                                         | Concrete Coating for FC12B                   | 10       | 18DEC10     | 27DEC10      | 32d         | Concrete Coating for FC12B                   |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 11060                                         | Backfilling for FC12B                        | 20       | 13DEC10     | 01JAN11      | 7d          | Backfilling for FC12B                        |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 12010                                         | Excavation for 11B                           | 21       | 11SEP10     | 01OCT10      | 0           | Excavation for 11B                           |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |
| 12020                                         | Pile Head Construction for FC11B             | 17       | 02OCT10     | 18OCT10      | 0           | Pile Head Construction for FC11B             |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |     |      |     |     |     |     |     |     |     |     |     |     |  |

|                           |         |
|---------------------------|---------|
| Start date                | 29JAN10 |
| Finish date               | 27APR13 |
| Data date                 | 29JAN10 |
| Run date                  | 06APR10 |
| Page number               | 1A      |
| © Primavera Systems, Inc. |         |

|  |                        |
|--|------------------------|
|  | Early bar              |
|  | Progress bar           |
|  | Critical bar           |
|  | Summary bar            |
|  | Start milestone point  |
|  | Finish milestone point |

**China Harbour Engineering Co. Ltd.**  
**TPSTW Stage 5 Phase 2B**

| Date    | Revision | Checked | Approved |
|---------|----------|---------|----------|
| 05FEB10 | 0        | WML     | TKC      |
| 07APR10 | 1        | AA      | TKC      |
|         |          |         |          |
|         |          |         |          |







