


China Harbour Engineering Company Limited

Contract No. DC/2009/09
Construction of Tai Po Sewage Treatment
Works – Stage V Phase II B

**Monthly Environmental Monitoring
and Audit Report for
July 2011**

(Version 2.0)

Certified By 
(Environmental Team Leader)

REMARKS:

The information supplied and contained within this report is, to the best of our knowledge, correct at the time of printing.

CINOTECH accepts no responsibility for changes made to this report by third parties.

CINOTECH CONSULTANTS LTD
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong
Tel: (852) 2151 2083 Fax: (852) 3107 1388
Email: info@cinotech.com.hk

TABLE OF CONTENTS

	Page
EXECUTIVE SUMMARY.....	1
Introduction.....	1
Environmental Monitoring and Audit Works.....	1
Environmental Licenses and Permits.....	2
Key Information in the Reporting Month.....	2
Future Key Issues.....	2
1 INTRODUCTION.....	3
Background.....	3
Construction Programme.....	4
Summary of EM&A Requirements.....	5
2 AIR QUALITY MONITORING.....	6
Monitoring Requirements.....	6
Monitoring Locations.....	6
Monitoring Equipment.....	6
Monitoring Parameters, Frequency and Duration.....	7
Monitoring Methodology and QA/QC Procedure.....	7
Results and Observations.....	8
3 NOISE MONITORING.....	10
Monitoring Requirements.....	10
Monitoring Locations.....	10
Monitoring Equipment.....	10
Monitoring Parameters, Frequency and Duration.....	10
Monitoring Methodology and QA/QC Procedures.....	11
Results and Observations.....	12
4 LANDFILL GAS MONITORING.....	13
Monitoring Requirements.....	13
Monitoring Parameters and Frequency.....	13
Monitoring Locations.....	13
Monitoring Equipment.....	13
Results.....	13
5 ENVIRONMENTAL AUDIT.....	14
Site Audits.....	14
Review of Environmental Monitoring Procedures.....	14
Status of Environmental Licensing and Permitting.....	14
Status of Waste Management.....	16
Implementation Status of Environmental Mitigation Measures.....	16
Summary of Exceedances.....	17
Implementation Status of Event Action Plans.....	17
Summary of Complaint and Prosecution.....	17
6 FUTURE KEY ISSUES.....	18
Monitoring Schedule for the Next Month.....	18
Construction Program for the Next Month.....	18

7 CONCLUSIONS AND RECOMMENDATIONS.....	19
Conclusions	19
Recommendations.....	19

LIST OF TABLES

Table I	Summary Table for Events Recorded in the Reporting Month
Table II	Summary Table for Key Information in the Reporting Month
Table 1.1	Key Project Contacts
Table 2.1	Locations for Air Quality Monitoring
Table 2.2	Air Quality Monitoring Equipment
Table 2.3	Impact Dust Monitoring Parameters, Frequency and Duration
Table 2.4	Summary Table of Air Quality Monitoring Results during the reporting month
Table 3.1	Location of Noise Monitoring Station
Table 3.2	Noise Monitoring Equipment
Table 3.3	Noise Monitoring Parameters, Frequency and Duration
Table 3.4	Summary Table of Noise Monitoring Results during the Reporting Month
Table 4.1	Landfill Gas Monitoring Equipment
Table 5.1	Summary of Environmental Licensing and Permit Status
Table 5.2	Observations and Recommendations of Site Audit

LIST OF FIGURE

Figure 1.1	Site Layout Plan
Figure 1.2	Locations of Air Quality and Noise Monitoring Stations
Figure 1.3	Landfill Gas Monitoring Area

LIST OF APPENDICES

Appendix A	Action and Limit Levels
Appendix B	Copies of Calibration Certificates
Appendix C	Environmental Monitoring Schedules
Appendix D	1-hour TSP Monitoring Results and Graphical Presentations
Appendix E	24-hour TSP Monitoring Results and Graphical Presentations
Appendix F	Noise Monitoring Results and Graphical Presentations
Appendix G	Records of Landfill Gas Measurement by the Contractor
Appendix H	Summary of Exceedance
Appendix I	Site Audit Summary
Appendix J	Event Action Plans
Appendix K	Updated Environmental Mitigation Implementation Schedule
Appendix L	Waste Generation in the Reporting Month
Appendix M	Complaint Log
Appendix N	Construction Programme

EXECUTIVE SUMMARY**Introduction**

1. This is the 13th monthly Environmental Monitoring and Audit (EM&A) Report prepared by Cinotech Consultants Limited for DSD Contract no. DC/2009/09 “Construction of Tai Po Sewage Treatment Works – Stage V Phase IIB”. This report documents the findings of EM&A Works conducted in July 2011.
2. The major site activities undertaken in the reporting month included:
 - Construction of Decanting Chamber, FC11B, FC12B, Chemical & Oil Store;
 - Dismantling works;
 - Diversion works;
 - Drainage and Excavation works;
 - Landscaping works;
 - Mini-piling works;
 - Pre-drilling works;
 - Steelworks for Shelter of Ferric Chloride Dosing System;
 - Proof drilling works;
 - Pipeline works; and
 - Paving works.

Environmental Monitoring and Audit Works

3. Environmental monitoring and audit works for the Project were performed regularly as stipulated in the Final EM&A Manual and the results were checked and reviewed. The implementation of the environmental mitigation measures, Event Action Plans and environmental complaint handling procedures were also checked.
4. Summary of the events and action taken in the reporting month is tabulated in **Table I**.

Table I Summary Table for Events Recorded in the Reporting Month

Parameter	No. of Exceedance		No. of Events Due to this Project	Action Taken
	Action Level	Limit Level		
1-hr TSP	0	0	0	N/A
24-hr TSP	0	0	0	N/A
Noise	0	0	0	N/A

5. In the reporting month, excavation works were undertaken within the 250m Consultation Zone of Shuen Wan Landfill. Landfill gas monitoring was performed by the Safety Officer of the Contractor. All the measured results were complied with the Limit Levels.

Environmental Licenses and Permits

6. Environmental related licenses/permits granted to the Project include the Environmental Permit (EP) for the Project, the Discharge Licence, Construction Noise Permit and the Waste Disposal (Chemical Waste) Licence.

Key Information in the Reporting Month

7. Summary of key information in this reporting month is tabulated in Table II.

Table II Summary Table for Key Information in the Reporting Month

Event	Event Details		Action Taken	Status	Remark
	Number	Nature			
Complaint received	0	---	N/A	N/A	---
Changes to the assumptions and key construction / operation activities recorded	0	---	N/A	N/A	---
Status of submissions under EP	1	Monthly EM&A Report (June 11)	Submitted to EPD on 20 th July 2011 (EP condition 6.6).	No comment	---
Notifications of any summons & prosecutions	0	---	N/A	N/A	---

Future Key Issues

8. Major site activities for the coming two months will include:
- Construction of Decanting Chamber, FC11B, FC12B, FMC2B, Aeration Tank No.5 & 6, Bio-gas Holding Tank Support & Valve Chamber;
 - Demolition Existing Final Settlement Tank No.8 & 9;
 - Drainage and Excavation works;
 - Finishing works for Decanting Chamber, Bund Wall of Ferric Chloride Dosing System and Chemical & Oil Store;
 - Landscaping works;
 - Mini-piling works at MCL;
 - Pre-drilling works for FC7B & FC10B;
 - Proof-drilling at SDT;
 - Roadwork in Portion “A”; and
 - Pipeline works.
9. The future environmental concerns are air quality, noise impacts, waste management and surface runoff from construction works.

1 INTRODUCTION


Background

- 1.1 Tai Po Sewage Treatment Works (TPSTW) is located within the Tai Po Industrial Estate. It currently comprises four Stages: I, II, IVA and IVB works. The TPSTW - Stage V aims to upgrade the existing STW to provide additional sewage treatment capacity from the present design flow of 88,000 m³/day to 130,000 m³/day to meet the demands of both the existing and future developments, and to meet the revised discharge license requirements.
- 1.2 The TPSTW Stage V, Phase I and Phase II are Designated Projects under the Environmental Impact Assessment Ordinance (Cap. 449) with the same EIAO Register No. AEIAR – 081/2004. A study of environmental impact assessment (EIA) was undertaken to evaluate various environmental impacts associated with the works within these two Designated Projects. An EIA Report as well as an Environmental Monitoring and Audit (EM&A) Manual were approved by the Environmental Protection Department (EPD) on 28 October 2004.
- 1.3 The Stage V works will be implemented in 2 phases. The design capacities of Phase I and Phase II works are 100,000 m³/d and 130,000 m³/d respectively. An Environmental Permit (EP) No. EP-265/2007 was issued on 22 March 2007 for the TPSTW Stage V Phase II to the Drainage Services Department (DSD) as the Permit Holder. The project “Tai Po Sewage Treatment Works – Stage V Phase IIB” formed part of the Phase II works, includes additional secondary treatment process units (1 primary clarifier; 3 bioreactors and 2 final clarifiers) in TPSTW for its future extended plant design capacity of 120,000 m³/day. A master construction programme of the Project is provided in **Appendix N**. A site layout plan is provided in **Figure 1.1**. The construction activities of the Project commenced on 3 July 2010.
- 1.4 Cinotech Consultants Ltd. was commissioned by the Contractor as the Environmental Team (ET) to undertake the EM&A works for the Project. Dr. Priscilla CHOY of Cinotech Consultants Ltd. was appointed as the ET Leader as per the Condition 2.1 of the EP. Ove Arup and Partners Hong Kong Limited. was appointed as the IEC under Condition 2.2 of the EP. This is the 13th monthly EM&A report summarizing the EM&A works for the Project in July 2011.

Project Organizations

- 1.5 Different parties with different levels of involvement in the project organization include:
 - Project Proponent / Engineer’s Representative (ER) – Drainage Services Department
 - Environmental Team (ET) – Cinotech Consultants Ltd.
 - Independent Environmental Checker (IEC) – Ove Arup and Partners Hong Kong Limited
 - Contractor – China Harbour Engineering Company Ltd.
- 1.6 The responsibilities of respective parties are detailed in Section 1.10 of the Final EM&A Manual of the Project.

1.7 The Project Organization during Construction Phase

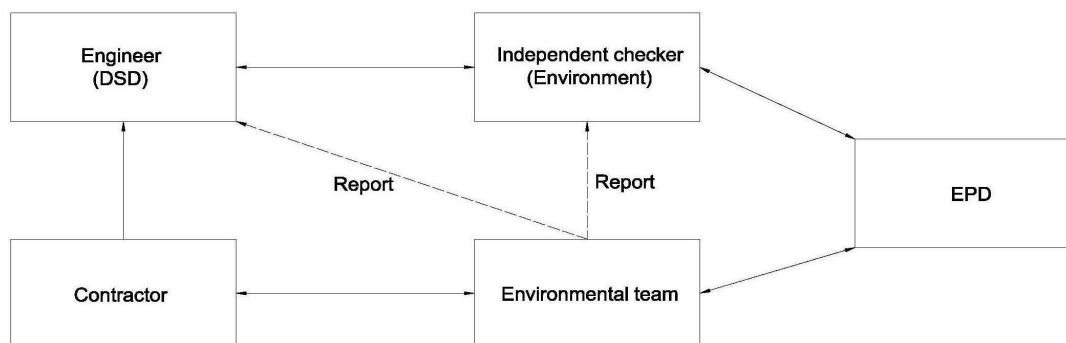

1.8 The key contacts of the Project are shown in **Table 1.1**.

Table 1.1 Key Project Contacts

Party	Role	Name	Position	Phone No.	Fax No.
DSD	SP Division	Mr. LAI cheuk-ho	Chief Engineer	2594 7500	2827 8700
		Mr. IP Shu-kuen	Senior Engineer	2594 7502	
		Mr. TSANG Lap-kei	Engineer	2594 7459	
Cinotech	Environmental Team	Dr. Priscilla CHOY	ET Leader	2151 2089	3107 1388
		Mr. TY YEUNG	Project Coordinator and Audit Team Leader	2151 2099	
		Mr. Henry LEUNG	Monitoring Team Leader	2151 2087	
Arup	Independent Environmental Checker	Mr. Coleman NG	Independent Environmental Checker	2268 3097	2865 6493
		Mr. Lawrence KAN	Assistant to Independent Environmental Checker	2268 3212	
CHEC	Civil Contractor	Mr. TK CHEUNG	Project Manager	9863 2954	2603 6899
		Mr. Aaron AU	Site Agent	6345 0754	
		Mr. Jason TSE	Environmental Offiecr	9320 3608	

Construction Programme

1.9 The site activities undertaken in the reporting month were:

- Construction of Decanting Chamber, FC11B, FC12B, Chemical & Oil Store;
- Dismantling works;
- Diversion works;
- Drainage and Excavation works;
- Landscaping works;
- Mini-piling works;
- Pre-drilling works;
- Steelworks for Shelter of Ferric Chloride Dosing System;
- Proof drilling works;
- Pipeline works; and
- Paving works.

Summary of EM&A Requirements

- 1.10 The EM&A programme requires construction phase air quality and noise monitoring as well as environmental site audits. The EM&A requirements are described in the following sections, including:
- All monitoring parameters;
 - Action and Limit levels for all environmental parameters;
 - Event / Action Plans;
 - Environmental mitigation measures, as recommended in the project EIA study final report; and
 - Environmental requirements in contract documents.
- 1.11 The advice on the implementation status of environmental protection and pollution control/mitigation measures is summarized in Section 5 of this report.
- 1.12 This report presents the monitoring results, observations, locations, equipment, period, methodology and QA/QC procedures of the required monitoring parameters, namely air quality and noise as well as audit works for the Project in the reporting month.

2 AIR QUALITY MONITORING

Monitoring Requirements

- 2.1 Monitoring of 1-hour and 24-hour Total Suspended Particulates (TSP) was conducted to monitor the air quality during construction phase. **Appendix A** shows the established Action/Limit Levels for the environmental monitoring works.
- 2.2 In accordance with Section 2.30 of the EM&A Manual, a baseline checking of ambient TSP levels shall be carried out every six months at each monitoring station, when no dusty works activities are in operation. The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.
- 2.3 The baseline checking was conducted on 25, 26 and 28 July 2011 for 1-hour TSP and 31 July 2011 for 24-hour TSP when no dusty works activities are in operation. The baseline checking results were reviewed within the range of baseline monitoring results which were presented in Baseline Monitoring Report. Therefore, the current Action and Limit levels for 1-hour TSP and 24-hour TSP monitoring are considered as still representative and valid.

Monitoring Locations

- 2.4 Impact air quality monitoring was conducted at the 3 monitoring stations, as shown in **Figure 1.2**. **Table 2.1** describes the locations of the air quality monitoring stations.

Table 2.1 Locations for Air Quality Monitoring

Monitoring Stations	Description	Location of Measurement
CAM1	Government Staff Quarters	Rooftop
CAM2	Hung Hing Printing Centre	On the site boundary just next to the Hung Hing Printing Centre
CAM3	Talcon Industrial Ltd.	On the site boundary just next to Talcon Industrial Ltd.

Monitoring Equipment

- 2.5 **Table 2.2** summarizes the equipment used for the air quality monitoring.

Table 2.2 Air Quality Monitoring Equipment

Equipment	Model and Make	Qty.
HVS	Graseby GMW 2310 HVS, Model GS-2310105-1, Serial no. 10239 and 0810	2
	Tisch Environmental, Inc.; Model no. TE-5170, Serial no. 1704	1
Calibrator	Thermo Andersen.; Model no. G25A Serial no. 1536	1

Monitoring Parameters, Frequency and Duration

- 2.6 **Table 2.3** summarizes the monitoring parameters and frequencies of impact dust monitoring for the whole construction period.

Table 2.3 Impact Dust Monitoring Parameters, Frequency and Duration

Monitoring Stations	Parameter	Duration	Period	Frequency
CAM1, CAM2 and CAM3	1-hour TSP	1 hour	During daytime period	3 times / 6-day
	24-hour TSP	24 hours	24 hours	Once / 6-day

Monitoring Methodology and QA/QC Procedure

Instrumentation

- 2.7 High Volume Samplers (HVS) connected with appropriate sampling inlets were employed for air quality monitoring. Each sampler was composed of a motor, a filter holder, a flow controller and a sampling inlet and its performance specification complies with that required by USEPA Standard Title 40, Code of Federation Regulations Chapter 1 (Part 50).

HVS Installation

- 2.8 The following guidelines were adopted during the installation of HVS:
- Sufficient support was provided to secure the samplers against gusty wind.
 - No two samplers were placed less than 2 meters apart.
 - The distance between the sampler and an obstacle, such as buildings, was at least twice the height that the obstacle protrudes above the sampler.
 - A minimum of 2 meters of separation from walls, parapets and penthouses was required for rooftop samples.
 - A minimum of 2 meters separation from any supporting structure, measured horizontally was required.
 - No furnaces or incineration flues were nearby.
 - Airflow around the sampler was unrestricted.
 - The samplers were more than 20 meters from the drip line.
 - Any wire fence and gate, to protect the sampler, should not cause any obstruction during monitoring.

Filters Preparation

- 2.9 Fiberglass filters were used which have a collection efficiency of larger than 99% for particles of 0.3 μm diameter. A HOKLAS accredited laboratory, Wellab Ltd., was responsible for the preparation of pre-weighed filter papers for Cinotech's monitoring team.
- 2.10 All filters, which were prepared by Wellab Ltd., were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25 °C and not variable by more than ± 3 °C; the relative humidity (RH) was <

50% and not variable by more than $\pm 5\%$. A convenient working RH was 40%.

2.11 Wellab Ltd. has a comprehensive quality assurance and quality control programmes.

Operating/Analytical Procedures

2.12 Operating/analytical procedures for the TSP monitoring were highlighted as follows:

- Prior to the commencement of the dust sampling, the flow rate of the HVS was properly set (between 1.1 and 1.4 m³/min.) in accordance with the manufacturer's instruction to within the range recommended in USEPA Standard.
- The power supply was checked to ensure the sampler worked properly.
- On sampling, the sampler was operated for 5 minutes to establish thermal equilibrium before placing any filter media at the air quality monitoring station.
- The filter holding frame was then removed by loosening the four nuts and carefully a weighted and conditioned filter was centered with the stamped number upwards, on a supporting screen.
- The filter was aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter. Then the filter holding frame was tightened to the filter holder with swing bolts to avoid air leakage at the edges.
- The shelter lid was closed and secured with the aluminum strip.
- The timer was then programmed. Information was recorded on the record sheet, which included the starting time, the weather condition and the filter number (the initial weight of the filter paper can be found out by using the filter number).
- The flow rate of the HVS sampler would be verified to be constant and recorded on the data sheet after sampling.
- After sampling, the filter was removed and sent to the Wellab Ltd. for weighing. The elapsed time was also recorded.
- Before weighing, all filters were equilibrated in a conditioning environment for 24 hours. The conditioning environment should be between 25°C and 30°C and not vary by more than $\pm 3^\circ\text{C}$; the relative humidity (RH) should be $< 50\%$ and not vary by more than $\pm 5\%$. A convenient working RH is 40%. Weighing results were returned to Cinotech for further analysis of TSP concentrations collected by each filter.

Maintenance/Calibration

2.13 The following maintenance/calibration was required for the HVS:

- The high volume motors and their accessories were properly maintained. Appropriate maintenance such as routine motor brushes replacement and electrical wiring checking were made to ensure that the equipment and necessary power supply are in good working condition.
- Calibration of the HVS (five point calibration) using Calibration Kit was carried out every two months. Copies of calibration certificates are attached in **Appendix B**.
- The HVS calibration orifice will be calibrated annually.

Results and Observations

2.14 In the reporting month, 1-hr TSP monitoring was carried out as schedule at each designated monitoring station on 14 occasions. 24-hr TSP monitoring was carried out as

scheduled at each designated monitoring station on 6 occasions. The monitoring schedule was updated and is shown in **Appendix C**. The weather during the monitoring sessions was mainly sunny, cloudy and rainy.

- 2.15 All measured 1-hr and 24-hr TSP levels were below the Action/Limit Levels. No exceedance was recorded in the reporting month.
- 2.16 The monitoring data and graphical presentations of 1-hour and 24-hour TSP monitoring results are shown in **Appendices D** and **E**, respectively.

Table 2.4 Summary Table of Air Quality Monitoring Results during the reporting month

Parameter	Minimum $\mu\text{g}/\text{m}^3$	Maximum $\mu\text{g}/\text{m}^3$	Average $\mu\text{g}/\text{m}^3$	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
1-hr TSP (CAM1)	52	137	82	315	500
24-hr TSP (CAM1)	26	56	39	171	260
1-hr TSP (CAM2)	64	134	95	336	500
24-hr TSP (CAM2)	32	62	48	177	260
1-hr TSP (CAM3)	65	120	95	344	500
24-hr TSP (CAM3)	41	85	55	192	260

- 2.17 According to our field observations, the major dust source identified at the designated air quality monitoring stations are as follows:

Station	Major Pollution Source
CAM1 – Government Staff Quarters	Road Traffic Dust
CAM2 – Hung Hing Printing Centre	Road Traffic Dust and Excavation
CAM3 – Talcon Industrial Ltd.	Road Traffic Dust and Excavation

3 NOISE MONITORING

Monitoring Requirements

- 3.1 Noise monitoring was conducted in accordance with the EM&A Manual. **Appendix A** shows the established Action and Limit Levels for the environmental monitoring works.
- 3.2 The number and location of monitoring stations and parameters shall be reviewed by ET Leader every three months according to section 8.8 of EM&A Manual.

Monitoring Locations

- 3.3 Noise monitoring was conducted at one designated monitoring station as presented in **Table 3.1**. **Figure 1.2** shows the locations of the monitoring station.

Table 3.1 Location of Noise Monitoring Station

Monitoring Station	Description	Location of Measurement
NM1	Government Staff Quarters	The corridor at the first floor.

Monitoring Equipment

- 3.4 **Table 3.2** summarizes the noise monitoring equipment model being used.

Table 3.2 Noise Monitoring Equipment

Equipment	Model and Make	Quantity
Integrating Sound Level Meter	SVAN 955 (Serial No. 14303)	1
Calibrator	SV30A (Serial No. 10965)	1
Wind Speed Anemometer	Vane Anemometer, Model 451104 (Serial no. 9020746)	1

Monitoring Parameters, Frequency and Duration

- 3.5 **Table 3.3** summarizes the monitoring parameters, frequency and total duration of monitoring.

Table 3.3 Noise Monitoring Parameters, Frequency and Duration

Station	Parameter	Period	Frequency
NM1	$L_{eq}(30 \text{ min.})$ (L_{10} and L_{90} were also recorded as supplementary information)	0700-1900 hrs. on normal weekdays	Once a week

- 3.6 If construction works are extended to include works during the hours of 1900 - 0700, additional weekly impact monitoring would be carried out during evening and night-time works. Applicable permits under NCO have been obtained by the Contractor. The details of the Construction Noise Permit can be referred to **Table 5.1**.

Monitoring Methodology and QA/QC Procedures

Field Monitoring

3.7 The monitoring procedures are as follows:

- The microphone head of the sound level meter was positioned 1m exterior of the noise sensitive facade and lowered sufficiently so that the building's external wall acts as a reflecting surface.
- The battery condition was checked to ensure good functioning of the meter.
- Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - frequency weighting : A
 - time weighting : Fast
 - measurement time : 30 minutes
- Prior to and after noise measurement, the meter was calibrated using the calibrator for 94.0 dB at 1000 Hz. If the difference in the calibration level before and after measurement is more than 1.0 dB, the measurement was considered invalid and repeat of noise measurement was required after re-calibration or repair of the equipment.
- The wind speed at the monitoring station was checked with the portable wind meter. Noise monitoring was cancelled in the presence of fog, rain, and wind with a steady speed exceeding 5 m/s, or wind with gusts exceeding 10 m/s.
- Noise measurement was paused during periods of high intrusive noise if possible and observation was recorded when intrusive noise was not avoided.
- At the end of the monitoring period, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.

Maintenance and Calibration

3.8 Maintenance and Calibration procedures were as follows:

- The microphone head of the sound level meter and calibrator were cleaned with a soft cloth at quarterly intervals.
- The sound level meter and calibrator were checked and calibrated at yearly intervals. Copies of calibration certificates are attached in **Appendix B**.

Results and Observations

- 3.9 In the reporting month, noise monitoring during non-restricted hours was conducted as scheduled at the designated location on 4 occasions. As advised by the Contractor, no construction activities will be undertaken during restricted hours as such noise monitoring during restricted hours was omitted. The noise monitoring schedule is provided in **Appendix C**.
- 3.10 The details of the monitoring results and graphical presentations are shown in **Appendix F**. The weather during the monitoring sessions was mainly sunny and fine.
- 3.11 No Action/Limit Level exceedance for construction noise monitoring was recorded in the reporting month.

Table 3.4 Summary Table of Noise Monitoring Results during the Reporting Month

Parameter	Minimum Leq(30min) dB(A)	Maximum Leq(30min) dB(A)	Average Leq(30min) dB (A)	Action Level	Limit Level
NM1	59.9	60.8	60.4	When one documented complaint is received	75dB(A)

- 3.12 According to our field observations, the major noise source identified at the designated air quality monitoring stations are as follows:

Station	Major Noise Source
NM1 – Government Staff Quarters	Road Traffic Construction of Main Site

4 LANDFILL GAS MONITORING

Monitoring Requirements

- 4.1 In accordance with Section 6 of the EM&A Manual, monitoring of landfill gas is required for construction works within the 250m Consultation Zone of Shuen Wan Landfill (the Consultation Zone). This Section reports the results of landfill gas measurements performed by the Safety Officer of the Contractor. **Appendix A** shows the Limit Levels for the monitoring works.

Monitoring Parameters and Frequency

- 4.2 The parameters for Landfill gas monitoring include Percentage of Combustible Gas (Methane), Carbon dioxide and Oxygen.
- 4.3 The Landfill gas monitoring is carried out before the entry of concern zone by the Contractor in the morning and afternoon.

Monitoring Locations

- 4.4 Monitoring of oxygen, methane and carbon dioxide was performed for excavations at 1m depth or more within the Consultation Zone. In this reporting month, the area required to be monitored for landfill gas are shown below and **Figure 1.3** shows the landfill gas monitoring locations.
- FC7B
 - FC8B
 - Aeration Tank
 - DN1500 Airmain

Remark:

Excavation works of 1m depth or more at FC11B&12B, Dewatering House, Pipe 300, 600 and 900 Excavation Trench has been completed.

Monitoring Equipment

- 4.5 **Table 4.1** summarizes the equipment employed by the Contractor for the landfill gas monitoring.

Table 4.1 Landfill Gas Monitoring Equipment

Equipment	Model and Make	Quantity
Intrinsically safe, portable gas detector	Crowcon Custodian CDL Portable Gas Detector (Serial No. 24800 37076)	1

Results

- 4.6 In the reporting month, landfill gas monitoring was carried out by the Contractor at the aforesaid locations on total 188 occasions. No Action/Limit Level exceedance for

Landfill gas monitoring was recorded in the reporting month. The monitoring results are provided in **Appendix G**. Copies of calibration certificates are attached in **Appendix B**.

5 ENVIRONMENTAL AUDIT

Site Audits

- 5.1 Site audits were carried out by ET on weekly basis to monitor the timely implementation of proper environmental management practices and mitigation measures in the Project site. The summaries of site audits are attached in **Appendix H**.
- 5.2 Site audits were conducted on 8th, 14th, 21st and 28th July 2011 by ET. A joint site audit with the representative with IEC, ER, the Contractor and the ET was carried out on 8th July 2011. No site inspection was conducted by EPD during the reporting month. The details of observations during site audit can refer to **Table 5.2**.

Review of Environmental Monitoring Procedures

- 5.3 The monitoring works conducted by the monitoring team were inspected regularly. The following observations have been recorded for the monitoring works:

Air Quality Monitoring

- The monitoring team recorded all observations around the monitoring stations within and outside the construction site.
- The monitoring team recorded the temperature and weather conditions on the monitoring days.

Noise Monitoring

- The monitoring team recorded all observations around the monitoring stations, which might affect the monitoring result.
- Major noise sources were identified and recorded. Other intrusive noise attributing to the result was trimmed off by pausing the monitoring temporarily.

Landfill Gas Monitoring

- The Contractor has checked the condition of the equipment before monitoring to ensure the reliability.

Status of Environmental Licensing and Permitting

- 5.4 All permits/licenses obtained for the Project are summarized in **Table 5.1**.

Table 5.1 Summary of Environmental Licensing and Permit Status

Permit / License No.	Valid Period		Details	Status
	From	To		
Environmental Permit (EP)				
EP-265/2007	22/3/2007	N/A	<p><u>Expansion and upgrading of existing Tai Po Sewage Treatment Works from 100,000 m³/day to 130,000 m³/day:</u></p> <p>(a) additional secondary treatment process units(1 primary clarified; 3 bioreactors and 2 final clarifiers);</p> <p>(b) reconstruction of 4 existing final clarified;</p> <p>(c) provision of ultraviolet disinfection facilities;</p> <p>(d) additional sludge treatment facilities; and</p> <p>(e) ancillary works to existing treatment facilities.</p>	Valid
Construction Noise Permit (CNP)				
GW-RN0036-11	01/02/11	31/07/11	<p>Use of powered mechanical equipment for carrying out construction work at 7 Dai Kwai Street, Tai Po Industrial Estate, Tai Po, N.T. during 0000 – 2400 hours on general holidays (including Sundays), 0000 – 0700 hours and 1900 – 2400 hours on any day not being a general holiday.</p>	Vaild
GW-RN0200-11	01/07/11	30/12/11		
Discharge Licence				
WT00007782-2010	25/10/10	31/10/15	<p>Discharge of industrial trade effluent:</p> <p><i>Water Control Zone:</i> Tolo Harbour and Channel</p> <p><i>Discharge Points:</i> Communal drain for the carriage of surface drainage water</p>	Valid
Waste Disposal (Chemical Waste)				
WPN : 5213-727-C2397-16	09/07/10	End of Project	Disposal of Chemical Waste including spent oil, lubricating oil, diesel oil and methanol, surplus paint, thinner	Valid

Status of Waste Management

- 5.5 The Construction and Demolition (C&D) materials generated in the reporting month were mainly inert C&D waste and C&D waste. The quantities of waste generated in this reporting month are summarized in **Appendix L**. No chemical waste was generated in the reporting month.

Implementation Status of Environmental Mitigation Measures

- 5.6 According to the EIA Study Report, Environmental Permit and the EM&A Manual of the Project, the mitigation measures detailed in the documents are recommended to be implemented during the construction phase. An updated summary of the EMIS is provided in **Appendix K**.
- 5.7 During site inspections in the reporting month, no non-conformance was identified. The observations and recommendations made during the audit sessions are summarized in **Table 5.2**.

Table 5.2 Observations and Recommendations of Site Audit

Parameters	Date	Observations and Recommendations	Follow-up
<i>Water Quality</i>	8-July-2011	<u>Reminder:</u> - The deposited mud should be cleared at wheel washing facility outside the site office.	The situation was observed rectified in audit session 110714.
	8-July-2011	<u>Reminder:</u> - The stagnant water should be cleared at FC7B.	The situation was observed rectified in audit session 110714.
	14-July-2011	<u>Reminder:</u> - Sand, silt and mud deposited should be cleaned along the channel opposite to Detritor.	The situation was observed rectified in audit session 110721.
<i>Air Quality</i>	8-July-2011	<u>Reminder:</u> - The Contractor was reminded to keep watering at A-Tank haul road, to avoid dust generation.	The situation was observed rectified in audit session 110714.
<i>Waste / Chemical Management</i>	14-July-2011	<u>Reminder:</u> - Construction materials should be disposed of or stored properly at FC8B.	The situation was observed rectified in audit session 110721.
	21-July-2011	<u>Observation:</u> - The deposited silt and mud was observed to be disposed along the haul road at FC11B&12B. The Contractor was reminded to clear the deposited silt, to avoid directing to the public during rain.	The situation was observed rectified in audit session 110728.
	21-July-2011	<u>Reminder:</u> - The general refuse with the rubbish bin should be cleared at FC11B&12B.	The situation was observed rectified in audit session 110728.
	28-July-2011	<u>Reminder:</u> - The worn sand bag should be cleared near the gully at FC11B&12B.	The situation required follow-up action during the coming audit session.
	28-July-2011	<u>Reminder:</u> - The deposited silt should be cleared along the haul road near FC11B&12B.	The situation required follow-up action during the coming audit session.

Summary of Exceedances

- 5.8 No exceedance of monitoring results was recorded in the reporting month. Summary of exceedance is provided in **Appendix H**.

Implementation Status of Event Action Plans

- 5.9 The Event Action Plans for air quality, construction noise and landfill gas monitoring are presented in **Appendix J**. No exceedance was recorded and thus no action was required to be implemented.

Summary of Complaint and Prosecution

- 5.10 No environmental related complaint, prosecution or notification of summons was received in the reporting month.
- 5.11 There was no environmental complaint, prosecution or notification of summons received since the Project commencement. The Complaint Log is attached in **Appendix M**.

6 FUTURE KEY ISSUES

6.1 Key issues to be considered in the coming month include:

- Effluent discharge generated from surface runoff;
- Dust generated from excavation works, backfilling works and stockpile of dusty materials;
- Maintenance of de-silting facilities and drainage system, such as U-channels;
- Accumulation of stagnant water in the site areas; and
- Accumulation of C&D waste and general waste on site.

Monitoring Schedule for the Next Month

6.2 The tentative environmental monitoring schedule for the next month is shown in **Appendix C**.

Construction Program for the Next Month

6.3 A tentative construction programme is provided in **Appendix N**. The major construction activities in the coming month will include:

- Construction of Decanting Chamber, FC11B, FC12B, FMC2B, Aeration Tank No.5 & 6, Bio-gas Holding Tank Support & Valve Chamber;
- Demolition Existing Final Settlement Tank No.8 & 9;
- Drainage and Excavation works;
- Finishing works for Decanting Chamber, Bund Wall of Ferric Chloride Dosing System and Chemical & Oil Store;
- Landscaping works;
- Mini-piling works at MCL;
- Pre-drilling works for FC7B & FC10B;
- Proof-drilling at SDT;
- Roadwork in Portion “A”; and
- Pipeline works.

7 CONCLUSIONS AND RECOMMENDATIONS

Conclusions

- 7.1 Environmental monitoring and audit works were conducted in the reporting month. Site inspections were conducted on a weekly basis. The results were reviewed and checked.
- 7.2 No exceedance of monitoring results was recorded in the reporting month.
- 7.3 There was no environmental complaint, prosecution or notification of summons received.

Recommendations

- 7.4 According to the environmental audit performed in the reporting month, the following recommendations were made:

Water Impact

- To provide sediment tank for settling runoff prior to disposal.
- To ensure proper use and maintenance of the de-silting facilities.
- To avoid accumulation of stagnant water on site.
- To maintain sand bags placed along the u-channel at good condition and replace the broken bags.
- To avoid blockage of gully inlets and ensure proper protection of the gully from ingress of sandy water.

Dust Impact

- To remove fugitive dusty material on the haul road periodically.
- To spray with water on the surface of concrete breaking and dry dust haul road.
- Excavated dusty materials or stockpile of dusty materials should be covered by impervious sheeting, or sprayed with water so as to maintain entire surface wet.


Noise Impact

- To space out noisy equipment and position as far away as possible from sensitive receivers.

Waste / Chemical Management

- To provide proper rubbish bins / skips for waste collection.
- To provide proper storage area for oil container on site.
- To avoid and check for any accumulation of waste materials or rubbish on site.
- To avoid any discharge or accidental spillage of chemical waste or oil directly from the equipment.
- Provide drip tray with adequate capacity and maintain well for equipment and chemical waste.

FIGURES

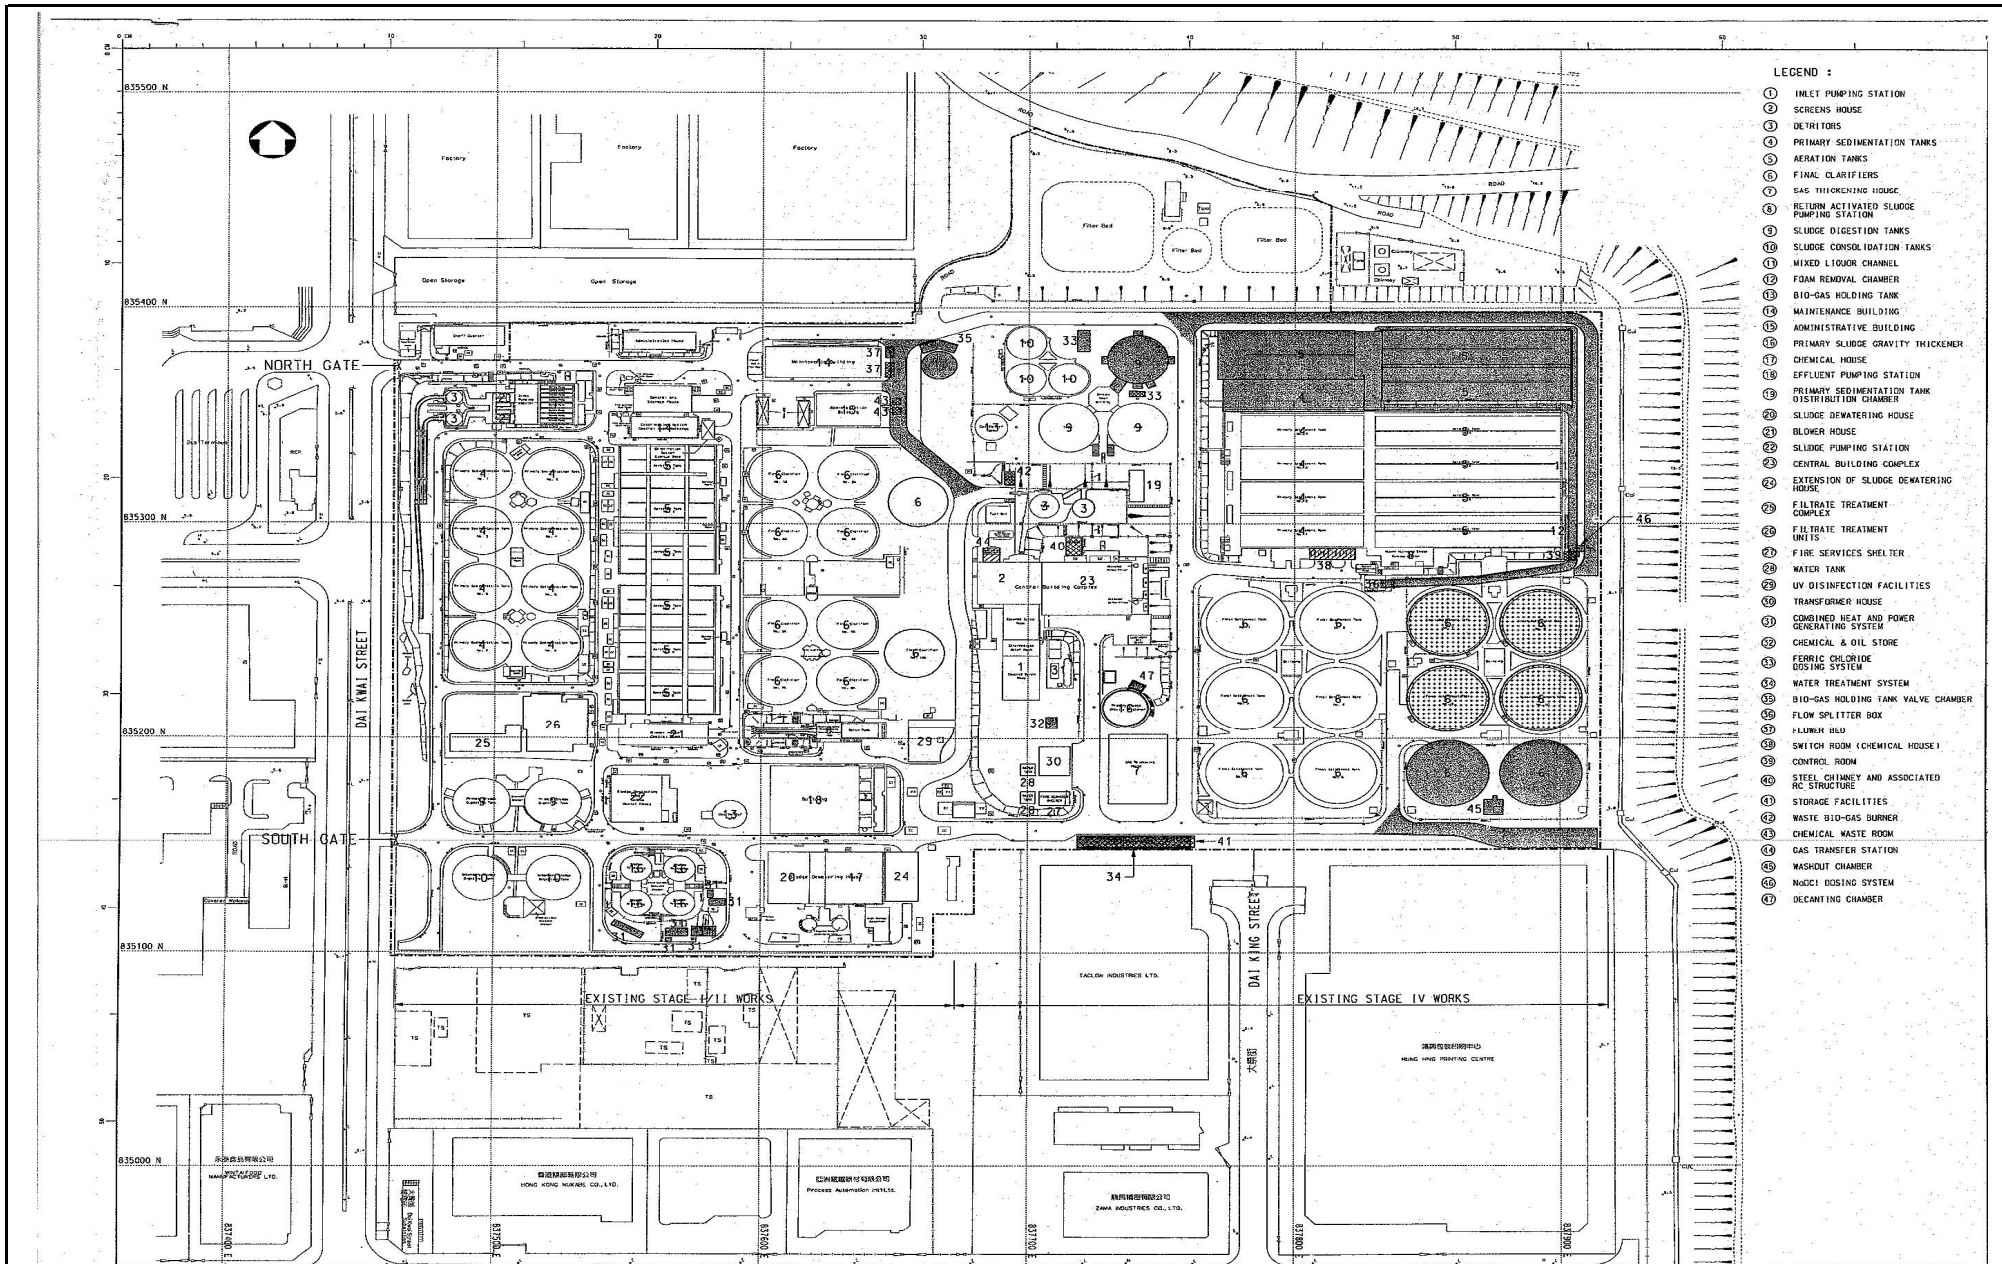


- LEGEND :
- ① INLET PUMPING STATION
 - ② SCREENS HOUSE
 - ③ DETRIERS
 - ④ PRIMARY SEDIMENTATION TANKS
 - ⑤ AERATION TANKS
 - ⑥ FINAL CLARIFIERS
 - ⑦ GAS THICKENING HOUSE
 - ⑧ REDUCED ACTIVATED SLUDGE PUMPING STATION
 - ⑨ SLUDGE DIGESTION TANKS
 - ⑩ SLUDGE CONSOLIDATION TANKS
 - ⑪ MIXED LIQUOR CHANNEL
 - ⑫ FOG REMOVAL CHAMBER
 - ⑬ BIO-GAS HOLDING TANK
 - ⑭ MAINTENANCE BUILDING
 - ⑮ ADMINISTRATIVE BUILDING
 - ⑯ PRIMARY SLUDGE GRAVITY THICKENER
 - ⑰ CHEMICAL HOUSE
 - ⑱ EFFLUENT PUMPING STATION
 - ⑲ PRIMARY SEDIMENTATION TANK DISTRIBUTION CHAMBER
 - ⑳ SLUDGE DEWATERING HOUSE
 - ㉑ BLOWER HOUSE
 - ㉒ SLUDGE PUMPING STATION
 - ㉓ CENTRAL BUILDING COMPLEX
 - ㉔ EXTENSION OF SLUDGE DEWATERING HOUSE
 - ㉕ FILTRATE TREATMENT COMPLEX
 - ㉖ FILTRATE TREATMENT UNITS
 - ㉗ FIRE SERVICES SHELTER
 - ㉘ WATER TANK
 - ㉙ UV DISINFECTION FACILITIES
 - ㉚ TRANSFORMER HOUSE
 - ㉛ COMBINED HEAT AND POWER GENERATING SYSTEM
 - ㉜ CHEMICAL & OIL STORE
 - ㉝ FERRIC CHLORIDE DOSING SYSTEM
 - ㉞ WATER TREATMENT SYSTEM
 - ㉟ BIO-GAS HOLDING TANK VALVE CHAMBER
 - ㊱ FLOW SPLITTER BOX
 - ㊲ FLUMM BELL
 - ㊳ SWITCH ROOM (CHEMICAL HOUSE)
 - ㊴ CONTROL ROOM
 - ㊵ STEEL CHIMNEY AND ASSOCIATED RC STRUCTURE
 - ㊶ STORAGE FACILITIES
 - ㊷ WASTE BIO-GAS BURNER
 - ㊸ CHEMICAL WASTE ROOM
 - ㊹ GAS TRANSFER STATION
 - ㊺ WASHOUT CHAMBER
 - ㊻ NODDI DOSING SYSTEM
 - ㊼ DEWATERING CHAMBER

TAI PO SEWAGE TREATMENT WORKS, STAGE V, PHASE IIB

PROJECT SITE LAYOUT PLAN (TPSTW)

Scale	N.T.S	Project No.	MA0010
Date	Jul-10	Figure	1.1



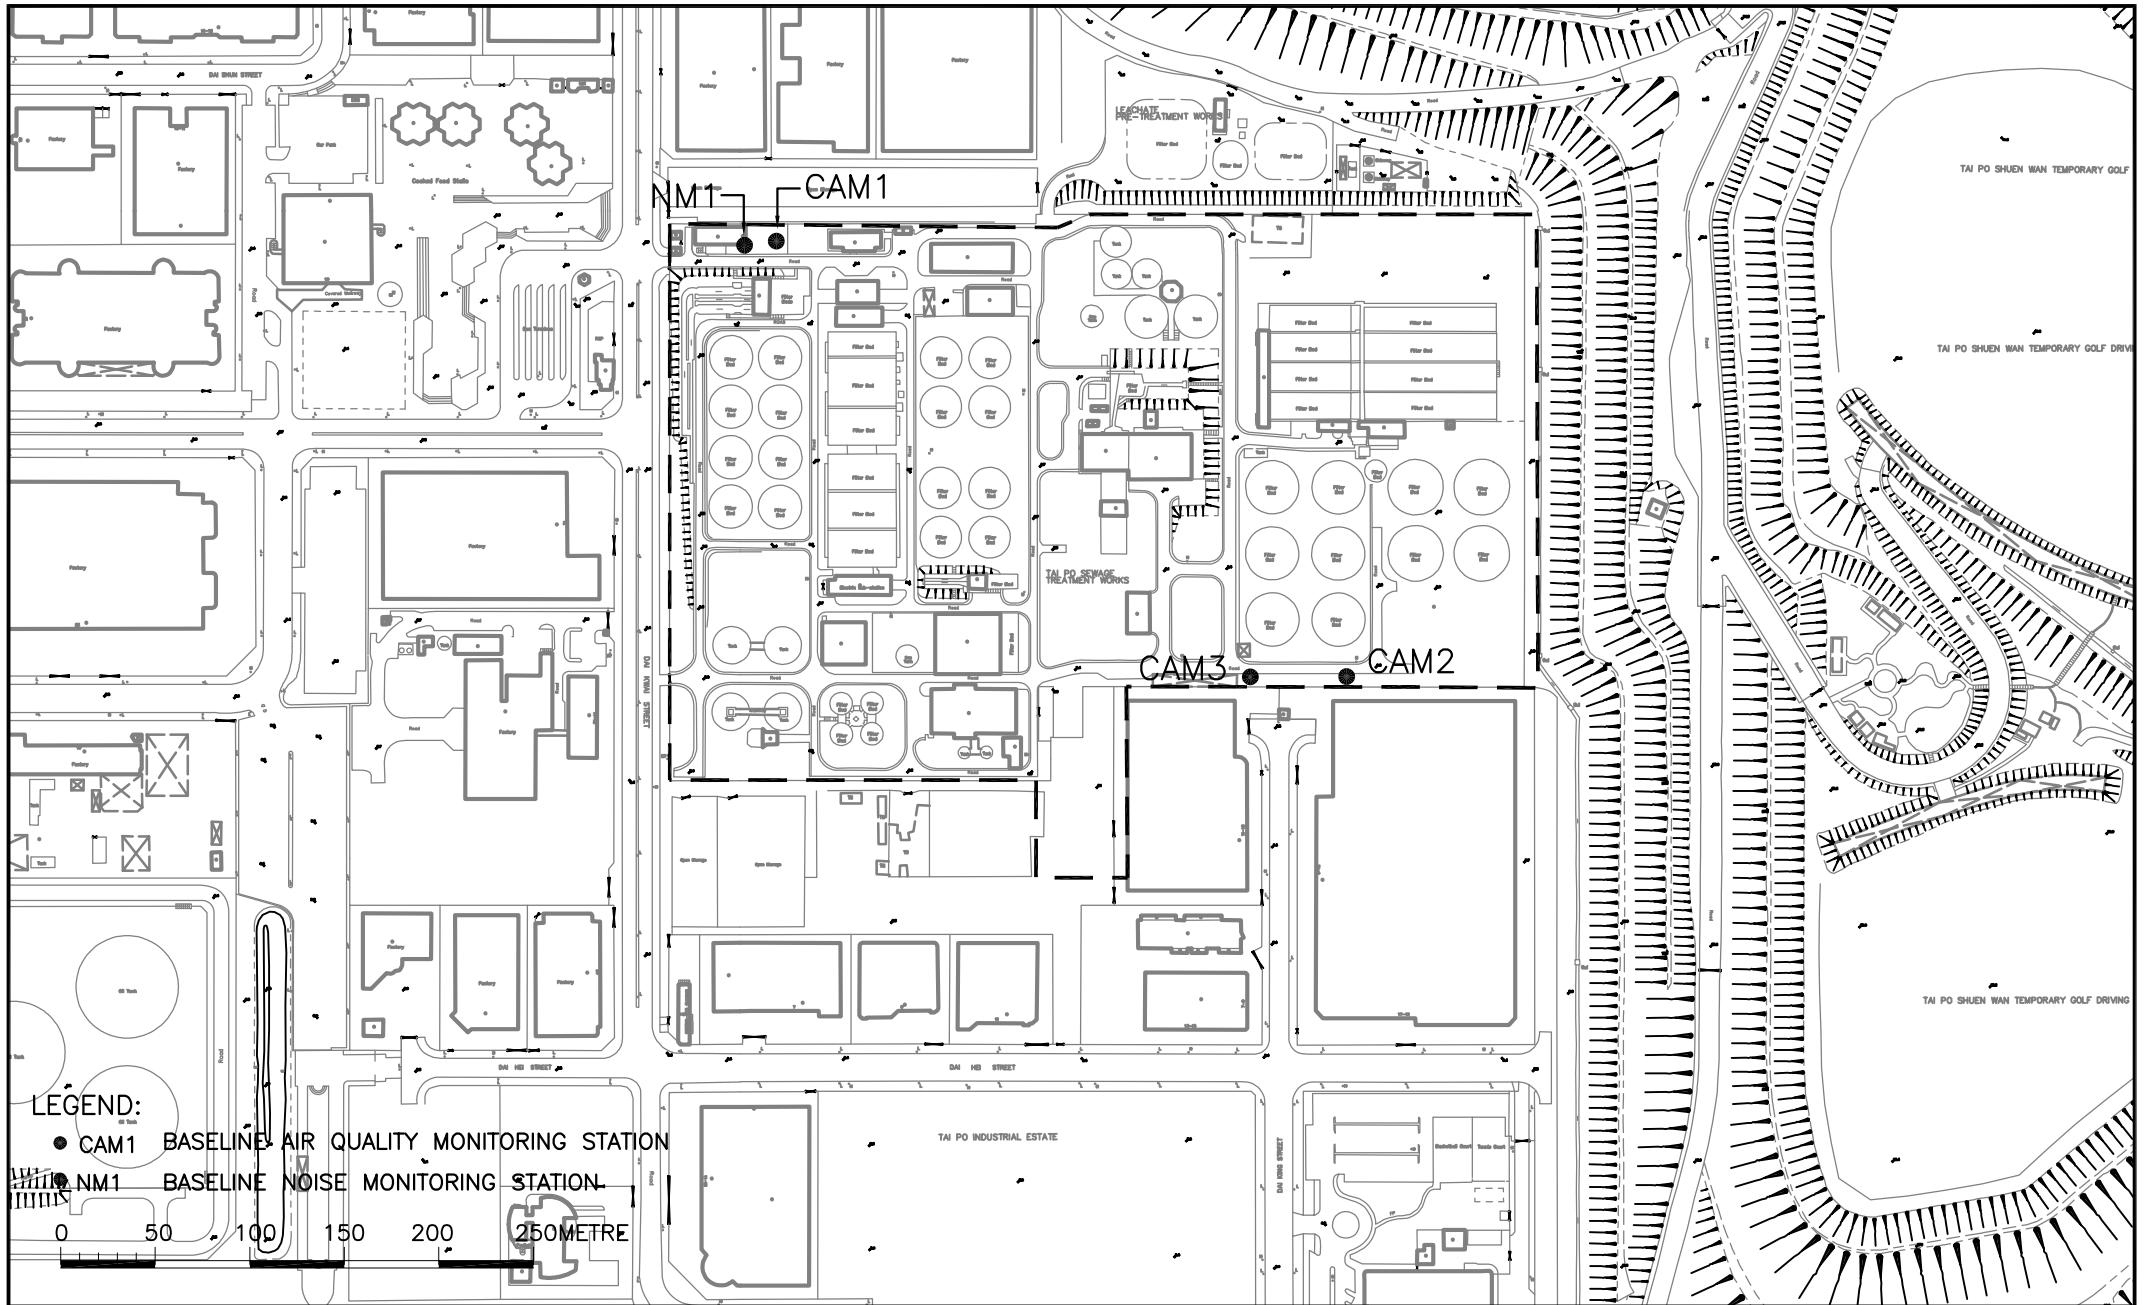

LEGEND:

- CAM1 BASELINE AIR QUALITY MONITORING STATION
- NM1 BASELINE NOISE MONITORING STATION


0 50 100 150 200 250METRE



Tai Po Sewage Treatment Work, Stage V, Phase IIB

LOCATIONS OF AIR QUALITY AND NOISE MONITORING STATIONS

SCALE	A4 1:4000	DATE	2010	
CHECK	IT	DRAWN	SL	
JOB No.	MA0010	DRAWING No.	1.2	REV —

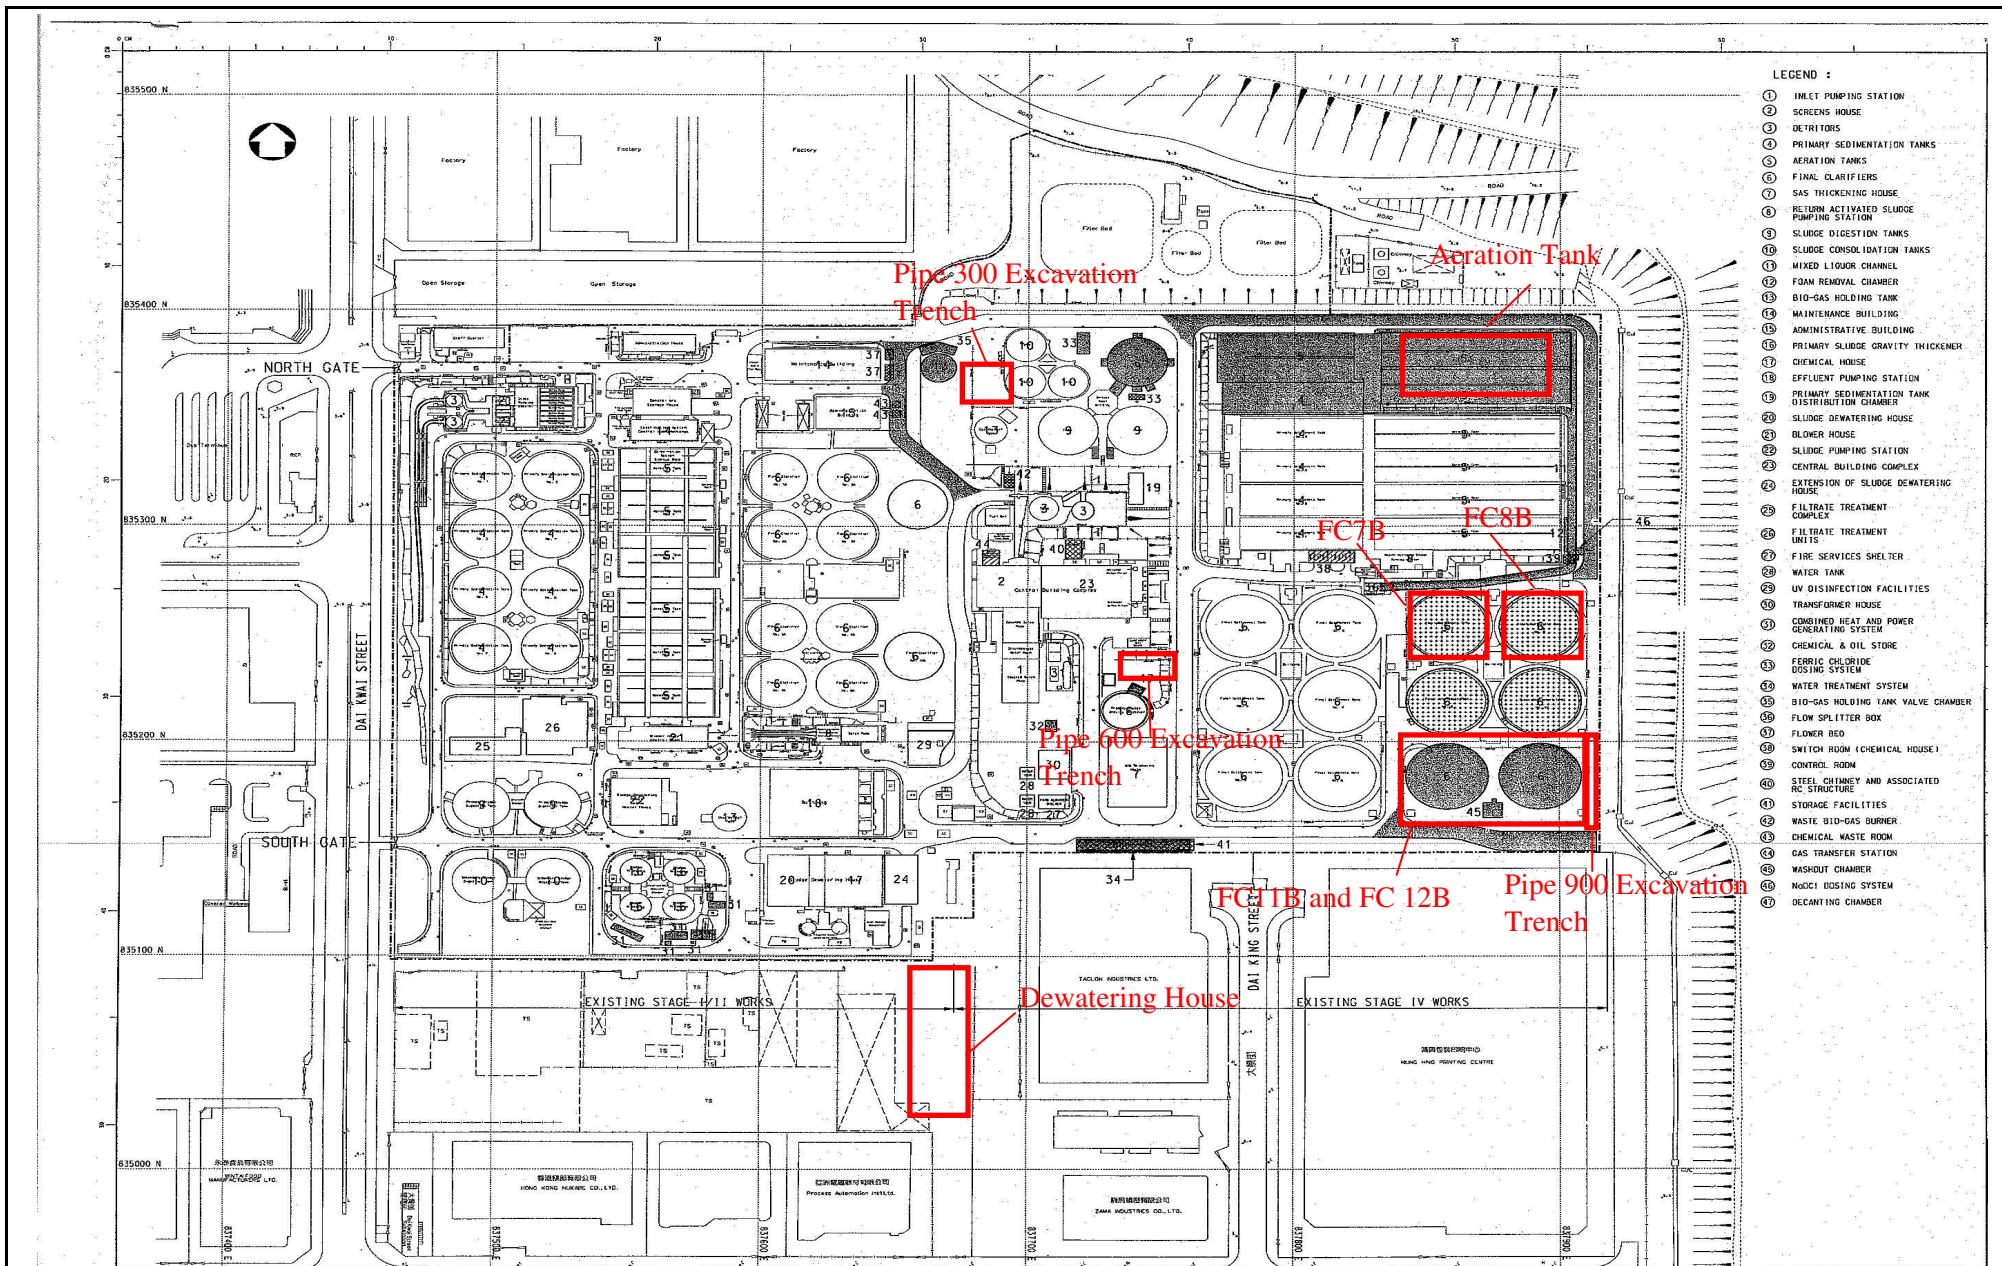

TAI PO SEWAGE TREATMENT WORKS, STAGE V, PHASE IIB

Landfill Gas Monitoring Area(TPSTW)

Scale	N.T.S	Project No.	MA0010
Date	Jul-11	Figure	1.3



**APPENDIX A
ACTION AND LIMIT LEVELS**

APPENDIX A – Action and Limit Levels**1-Hour TSP**

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
CAM1	315	500
CAM2	336	
CAM3	344	

24-Hour TSP

Location	Action Level, $\mu\text{g}/\text{m}^3$	Limit Level, $\mu\text{g}/\text{m}^3$
CAM1	171	260
CAM2	177	
CAM3	192	

Construction Noise

Time Period	Action Level	Limit Level
0700-1900 hrs on normal weekdays	When one documented complaint is received	75 dB(A)
0700-2300 hrs on holidays; and 1900-2300 hrs on all other days		70* dB(A)
2300-0700 hrs of next day		55* dB(A)

Notes:

* The Area Sensitivity Rating for Station NM1 is taken as C, due to the nearby industrial area, according to Table 1 of EPD's Technical Memorandum on Noise from Construction Work other than Percussive Piling.

Landfill Gas

Parameter	Limit Level	Action
Oxygen	<19%	Ventilate to restore oxygen to >19%
	<18%	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore oxygen to >19%
Methane	>10% LEL (i.e. >0.5% by volume)	Post “No Smoking” signs Prohibit hot works Ventilate to restore methane to <10% LEL
	>20% LEL (i.e. >1% by volume)	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore methane to <10%
Carbon Dioxide	>0.5%	Ventilate to restore carbon dioxide to <0.5%
	>1.5%	Stop works Evacuate personnel / prohibit entry Increase ventilation to restore carbon dioxide to <0.5%

**APPENDIX B
COPIES OF CALIBRATION
CERTIFICATES**

High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA0010/A40/0038

Station CAM2 - Hung Hing Printing Centre Operator: WK
 Date: 23-May-11 Next Due Date: 22-Jul-11
 Equipment No.: A-01-40 Serial No. 10239

Ambient Condition			
Temperature, Ta (K)	296	Pressure, Pa (mmHg)	759.1

Orifice Transfer Standard Information					
Equipment No.:	A-04-01	Slope, mc	0.0462	Intercept, bc	-0.0163
Last Calibration Date:	11-Oct-10	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	9-Oct-11	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] ^{1/2}	Qstd (CFM) X - axis	ΔW (HVS), in. of oil	[ΔW x (Pa/760) x (298/Ta)] ^{1/2} Y-axis
1	11.8	3.44	74.91	8.4	2.91
2	9.8	3.14	68.30	6.5	2.56
3	7.4	2.73	59.40	4.8	2.20
4	5.1	2.26	49.37	3.2	1.79
5	3.3	1.82	39.78	2.1	1.45

By Linear Regression of Y on X
 Slope, mw = 0.0410 Intercept, bw = -0.2085
 Correlation coefficient* = 0.9980

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation	
From the TSP Field Calibration Curve, take Qstd = 43 CFM	
From the Regression Equation, the "Y" value according to	
$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$	
Therefore, Set Point; W = (mw x Qstd + bw) ² x (760 / Pa) x (Ta / 298) =	<u>2.40</u>

Remarks: _____

Conducted by: Wk Tang Signature: [Signature] Date: 23/5/11
 Checked by: [Signature] Signature: [Signature] Date: 23 May 2011

High-Volume TSP Sampler 5-POINT CALIBRATION DATA SHEET

CINOTECH

File No. MA0010/A40/0039

Station: CAM2 - Hung Hing Printing Centre Operator: WK
 Date: 22-Jul-11 Next Due Date: 21-Sep-11
 Equipment No.: A-01-40 Serial No.: 10239

Ambient Condition			
Temperature, Ta (K)	304.3	Pressure, Pa (mmHg)	756.8

Orifice Transfer Standard Information					
Equipment No.:	A-04-01	Slope, mc	0.0462	Intercept, bc	-0.0163
Last Calibration Date:	11-Oct-10	$mc \times Qstd + bc = [\Delta H \times (Pa/760) \times (298/Ta)]^{1/2}$			
Next Calibration Date:	9-Oct-11	$Qstd = \{[\Delta H \times (Pa/760) \times (298/Ta)]^{1/2} - bc\} / mc$			

Calibration of TSP Sampler					
Calibration Point	Orifice			HVS	
	ΔH (orifice), in. of water	[ΔH x (Pa/760) x (298/Ta)] ^{1/2}	Qstd (CFM) X - axis	ΔW (HVS), in. of oil	[ΔW x (Pa/760) x (298/Ta)] ^{1/2} Y-axis
1	11.7	3.38	73.47	7.8	2.76
2	9.9	3.11	67.61	6.6	2.54
3	7.5	2.70	58.89	5.2	2.25
4	5.2	2.25	49.09	3.1	1.74
5	3.4	1.82	39.77	2.0	1.40

By Linear Regression of Y on X

Slope, mw = 0.0411 Intercept, bw = -0.2398

Correlation coefficient* = 0.9972

*If Correlation Coefficient < 0.990, check and recalibrate.

Set Point Calculation

From the TSP Field Calibration Curve, take Qstd = 43 CFM

From the Regression Equation, the "Y" value according to

$$mw \times Qstd + bw = [\Delta W \times (Pa/760) \times (298/Ta)]^{1/2}$$

Therefore, Set Point; W = (mw x Qstd + bw)² x (760 / Pa) x (Ta / 298) = 2.40

Remarks: _____

Conducted by: Wk Tang
 Checked by: W

Signature: [Signature]
 Signature: _____

Date: 22/7/11
 Date: 22 July 2011

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/11/110503
Date of Issue:	2011-05-03
Date Received:	2011-04-29
Date Tested:	2011-04-29
Date Completed:	2011-05-03
Next Due Date:	2012-05-02

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description : RS232 Integral Vane Digital Anemometer
Manufacturer : AZ Instrument
Model No. : AZ8904
Serial No. : 974835
Equipment No. : A-03-03

Test conditions:

Room Temperature : 23 degree Celsius
Relative Humidity : 65%
Pressure : 101.3 kPa

Methodology:

The anemometer has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

	Reference Set Point	Instrument Readings
Measuring Air Velocity, m/s	2.00	2.00
Temperature, °C	21.0	21.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Laboratory Manager

TEST REPORT

Description	Calibration Orifice	Manufacturer	Thermo Andersen
Serial No.	1536	Temperature, Ta (K)	295
Model No.	G25A	Pressure, Pa (mmHg)	751.5
Date	11 October 2010		

Plate	Diff.Vol (m ³)	Diff.Time (min)	Diff.Hg (mm)	Diff.H ₂ O (in.)
1	1.00	1.3050	3.8	1.50
2	1.00	0.9250	7.6	3.00
3	1.00	0.8540	8.9	3.50
4	1.00	0.7530	11.4	4.50
5	1.00	0.6210	16.5	6.50

DATA TABULATION

Vstd	(X axis) Qstd	(Y axis)
0.9938	0.7615	1.2240
0.9888	1.0689	1.7311
0.9870	1.1558	1.8698
0.9837	1.3064	2.1201
0.9769	1.5732	2.5481

Y axis= $\text{SQRT}[\text{H}_2\text{O}(\text{Pa}/760)(298/\text{Ta})]$
Qstd Slope (m) = 1.63228
Intercept (b) = -0.01631
Coefficient (r) = 0.99998

Va	(X axis) Qa	(Y axis)
0.9949	0.7624	0.7674
0.9899	1.0701	1.0852
0.9882	1.1571	1.1722
0.9848	1.3079	1.3291
0.9780	1.5749	1.5974

Y axis= $\text{SQRT}[\text{H}_2\text{O}(\text{Ta}/\text{Pa})]$
Qa Slope (m) = 1.02211
Intercept (b) = -0.01022
Coefficient (r) = 0.99998

CALCULATIONS

$V_{std} = \text{Diff. Vol}[(\text{Pa} - \text{Diff. Hg})/760](298/\text{Ta})$
 $Q_{std} = V_{std}/\text{Time}$
 $V_a = \text{Diff. Vol}[(\text{Pa} - \text{Diff. Hg})/\text{Pa}]$
 $Q_a = V_a/\text{Time}$


For subsequent flow rate calculations:
 $Q_{std} = 1/m\{[\text{SQRT}(\text{H}_2\text{O}(\text{Pa}/760)(298/\text{Ta}))] - b\}$
 $Q_a = 1/m\{[\text{SQRT}(\text{H}_2\text{O}(\text{Ta}/\text{Pa}))] - b\}$

PREPARED AND CHECKED BY:
For and On Behalf of **WELLAB Ltd.**



PATRICK TSE
Laboratory Manager

TEST REPORT

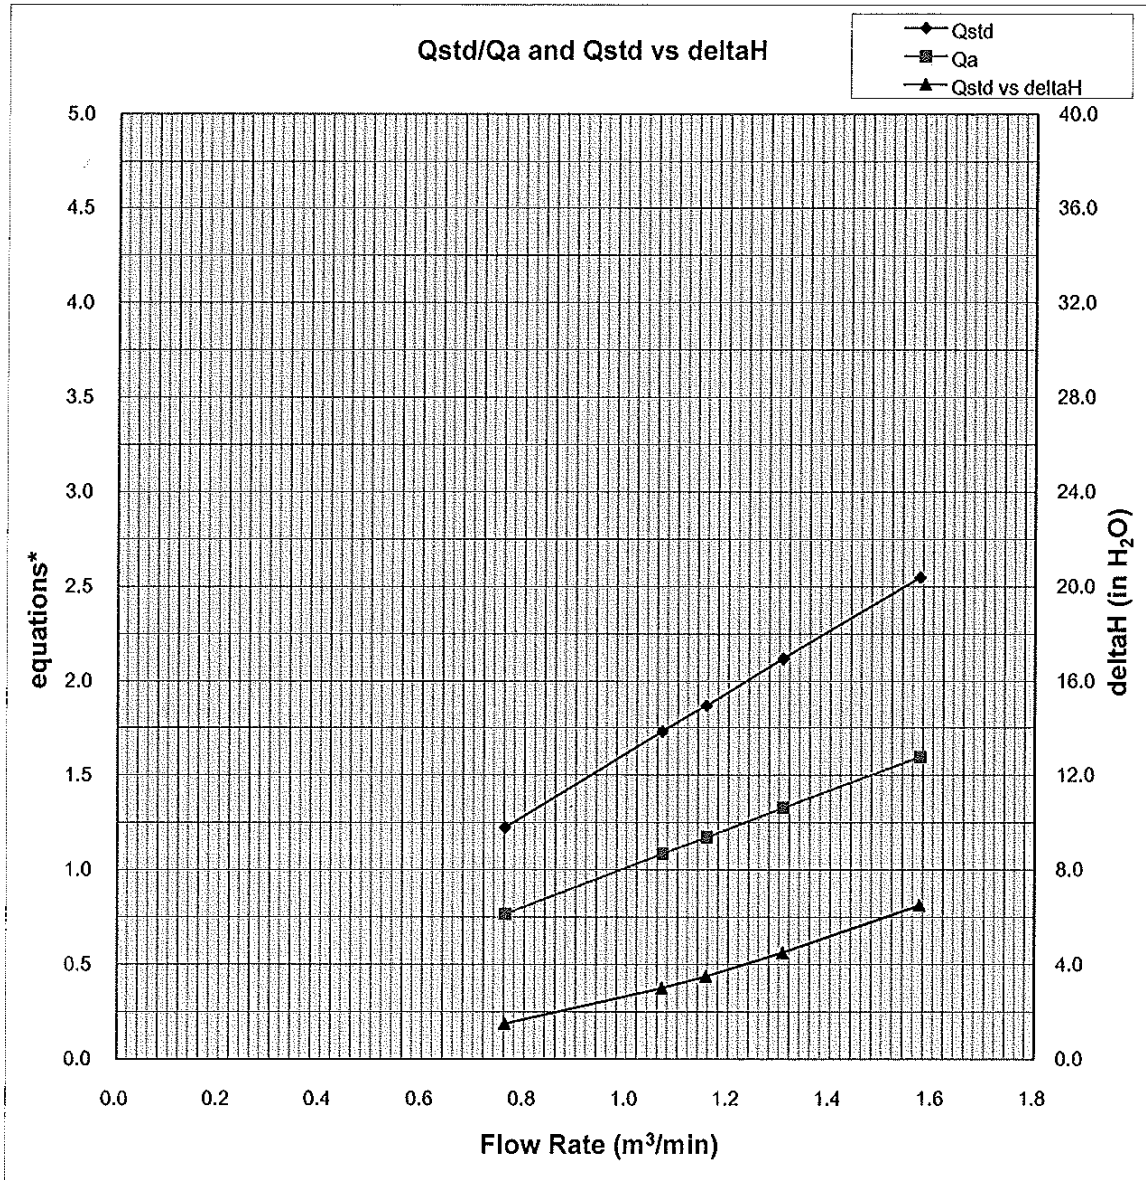

Y-axis equations:

Qstd series: $\text{SQRT}[\Delta H(\text{Pa}/\text{Pstd})(\text{Tstd}/\text{Ta})]$

Qa series: $\text{SQRT}[\Delta H(\text{Ta}/\text{Pa})]$

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/N/110124/1
Date of Issue:	2011-01-24
Date Received:	2011-01-21
Date Tested:	2011-01-21
Date Completed:	2011-01-24
Next Due Date:	2012-01-23

ATTN: Mr. Henry Leung

Page: 1 of 1

Certificate of Calibration

Item for calibration:

Description	: 'SVANTEK' Integrating Sound Level Meter
Manufacturer	: SVANTEK
Model No.	: SVAN 955
Serial No.	: 14303
Microphone No.	: 17204
Equipment No.	: N-08-05

Test conditions:

Room Temperature	: 23 degree Celsius
Relative Humidity	: 55%

Test Specifications:

Performance checking at 94 and 114 dB

Methodology:


In-house method, according to manufacturer instruction manual

Results:

Reference Set Point, dB	Instrument Readings, dB
94	94.0
114	114.0

PREPARED AND CHECKED BY:

For and On Behalf of **WELLAB Ltd.**



PATRICK TSE

Laboratory Manager

TEST REPORT

APPLICANT: Cinotech Consultants Limited
Room 1710, Technology Park,
18 On Lai Street,
Shatin, NT, Hong Kong

Test Report No.:	C/N/101110/1
Date of Issue:	2010-11-10
Date Received:	2010-11-08
Date Tested:	2010-11-08
Date Completed:	2010-11-10
Next Due Date:	2011-11-09

ATTN: Mr. Henry Leung

Page: 1 of 1

Item for calibration:

Description	: Acoustical Calibrator
Manufacturer	: SVANTEK
Model No.	: SV30A
Serial No.	: 10965
Equipment No.	: N-09-02

Test conditions:

Room Temperature	: 22 degree Celsius
Relative Humidity	: 57%

Methodology:

The Sound Level Calibrator has been calibrated in accordance with the documented procedures and using standard(s) and instrument(s) which are recommended by the manufacturer, or equivalent.

Results:

Sound Pressure Level (1kHz)	Measured SPL	Tolerance
At 94 dB SPL	94.0	94.0 ± 0.1 dB
At 114 dB SPL	114.0	114.0 ± 0.1 dB

PREPARED AND CHECKED BY:
For and On Behalf of **WELLAB Ltd.**


PATRICK TSE
Laboratory Manager



Calibration Certificate

Number: CCP/60118

Customer Name: China Harbour Engineering Co; Ltd
Address: 19/F, China Harbour Building,
370-374 King's Road, North Point.
Hong Kong.
Contact Person: Mr. Cheung
Detector Model: Crowcon Custodian CDL Portable Gas Detector
Serial Number: 24800 37076

Sensor Type	Measuring Range	Alarm Level Settings				Test Gas	Result
		Alarm 1	Alarm 2	STEL	LTEL		
CH4	0 to 100%LEL	20	40	NA	NA	50%LEL	Passed
H2S	0 to 25ppm	5	10	10	5	25ppm	Passed
O2	0 to 25%v/v	19.5	23.0	NA	NA	18.5%v/v	Passed
CO	0 to 250ppm	25	100	200	30	200ppm	Passed

Next Calibration Date: 12th Aug 2011

Remarks:

1. "Passed" refers to the detector has been successfully calibrated to meet with manufacturer tolerance of the instrument & sensor specification and repeatability $\pm 5\%$ FSD.
2. The above equipment has been tested and calibrated in accordance with procedures referred to in Crowcon's BSI validated ISO9001 quality manual. Test equipment used has been factory calibrated and is traceable to national standards. Canned calibration gas has been prepared in accordance with BS4559 and original gas mixture has been prepared using NPL (UK) certified Gravimetric Standard. Gas generator has been tested to meet with: Mil Std 45662A / ANSI/NCSL Z540-1

Authorized Signature

Date: 13/08/2010



FireMark Hong Kong Limited
Unit 901, 9/F., Lai Sun Commercial Center, 680 Cheung Sha Wan Road, Kowloon,
Hong Kong

Tel : (852) 2751 8871 Fax : (852) 2751 8806

**APPENDIX C
ENVIRONMENTAL MONITORING
SCHEDULE**

**Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B
Impact Air Quality and Noise Monitoring Schedule for July 2011**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					1-Jul	2-Jul
3-Jul	4-Jul	5-Jul	6-Jul	7-Jul	8-Jul	9-Jul
		1 hr TSP	1 hr TSP 24 hr TSP	1 hr TSP Noise		
10-Jul	11-Jul	12-Jul	13-Jul	14-Jul	15-Jul	16-Jul
		1 hr TSP Noise 24 hr TSP	1 hr TSP	1 hr TSP		
17-Jul	18-Jul	19-Jul	20-Jul	21-Jul	22-Jul	23-Jul
	24 hr TSP	1 hr TSP	1 hr TSP	1 hr TSP Noise		24 hr TSP
24-Jul	25-Jul	26-Jul	27-Jul	28-Jul	29-Jul	30-Jul
	1 hr TSP	1 hr TSP	1 hr TSP Noise		24 hr TSP	

**Contract No. DC/2009/09 - Construction of Tai Po Sewage Treatment Works - Stage 5 Phase 2B
Tentative Impact Air Quality and Noise Monitoring Schedule for August 2011**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	1-Aug	2-Aug	3-Aug	4-Aug	5-Aug	6-Aug
		1 hr TSP	1 hr TSP	1 hr TSP Noise 24 hr TSP		
7-Aug	8-Aug	9-Aug	10-Aug	11-Aug	12-Aug	13-Aug
		1 hr TSP	1 hr TSP Noise 24 hr TSP	1 hr TSP		
14-Aug	15-Aug	16-Aug	17-Aug	18-Aug	19-Aug	20-Aug
	1 hr TSP	24 hr TSP	1 hr TSP	1 hr TSP Noise		
21-Aug	22-Aug	23-Aug	24-Aug	25-Aug	26-Aug	27-Aug
	24 hr TSP	1 hr TSP	1 hr TSP	1 hr TSP Noise		24 hr TSP
28-Aug	29-Aug	30-Aug	31-Aug			
	1 hr TSP	1 hr TSP Noise				

The schedule may be changed due to unforeseen circumstances (adverse weather, etc)

**APPENDIX D
1-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix D - 1-hour TSP Monitoring Results

Station CAM1

Government Staff Quarters

Date	Sampling Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
5-Jul-11	16:00	Sunny	305.7	757.3	3.3736	3.3811	0.0075	16062.1	16063.1	1.0	1.21	1.21	1.21	72.5	103
6-Jul-11	9:00	Sunny	302.7	757.1	3.3657	3.3757	0.0100	16063.1	16064.1	1.0	1.21	1.21	1.21	72.8	137
7-Jul-11	16:30	Sunny	302.9	756.5	3.3383	3.3431	0.0048	16088.1	16089.1	1.0	1.21	1.21	1.21	72.8	66
12-Jul-11	9:00	Cloudy	299.4	753.6	3.3521	3.3571	0.0050	16089.1	16090.1	1.0	1.22	1.22	1.22	73.0	68
13-Jul-11	15:34	Cloudy	301.3	753.7	3.3511	3.3559	0.0048	16114.1	16115.1	1.0	1.21	1.21	1.21	72.8	66
14-Jul-11	13:05	Cloudy	300.3	754.5	3.3865	3.3910	0.0045	16115.1	16116.1	1.0	1.22	1.22	1.22	73.0	62
19-Jul-11	13:20	Cloudy	300.9	751.7	3.4043	3.4081	0.0038	16140.1	16141.1	1.0	1.21	1.21	1.21	72.8	52
20-Jul-11	9:00	Cloudy	298.6	754.1	3.4099	3.4143	0.0044	16141.1	16142.1	1.0	1.22	1.22	1.22	73.2	60
21-Jul-11	9:00	Sunny	300.2	756.6	3.4270	3.4339	0.0069	16142.1	16143.1	1.0	1.22	1.22	1.22	73.1	94
25-Jul-11	14:00	Sunny	304.6	756.6	3.3868	3.3939	0.0071	16168.1	16169.1	1.0	1.21	1.21	1.21	72.8	98
26-Jul-11	9:00	Sunny	302.1	759.2	3.3792	3.3872	0.0080	16169.1	16170.1	1.0	1.22	1.22	1.22	73.1	109
28-Jul-11	9:00	Sunny	302.6	757.1	3.3902	3.3949	0.0047	16171.1	16172.1	1.0	1.22	1.22	1.22	73.0	64
													Min		52
													Max		137
													Average		82

Station CAM2

Heng Hing Printing Centre

Date	Sampling Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
5-Jul-11	16:00	Sunny	305.7	757.3	3.4020	3.4072	0.0052	25239.2	25240.2	1.0	1.20	1.20	1.20	71.9	72
6-Jul-11	13:00	Sunny	305.9	755.3	3.3586	3.3682	0.0096	25240.2	25241.2	1.0	1.20	1.20	1.20	71.8	134
7-Jul-11	16:30	Sunny	302.9	756.5	3.3733	3.3820	0.0087	25265.2	25266.2	1.0	1.20	1.20	1.20	72.1	121
12-Jul-11	9:00	Cloudy	299.4	753.6	3.3646	3.3692	0.0046	25266.2	25267.2	1.0	1.21	1.21	1.21	72.4	64
13-Jul-11	15:00	cloudy	301.3	753.7	3.3783	3.3855	0.0072	25289.2	25290.2	1.0	1.20	1.20	1.20	72.2	100
14-Jul-11	13:00	Cloudy	300.3	754.5	3.3991	3.4044	0.0053	25290.2	25291.2	1.0	1.21	1.21	1.21	72.3	73
19-Jul-11	13:00	Cloudy	300.9	751.7	3.3907	3.4002	0.0095	25315.2	25316.2	1.0	1.20	1.20	1.20	72.1	132
20-Jul-11	9:00	Cloudy	298.6	754.1	3.4111	3.4159	0.0048	25316.2	25317.2	1.0	1.21	1.21	1.21	72.5	66
21-Jul-11	9:00	Sunny	300.2	756.6	3.4150	3.4204	0.0054	25317.2	25318.2	1.0	1.21	1.21	1.21	72.4	75
25-Jul-11	14:00	Sunny	304.6	756.6	3.4214	3.4299	0.0085	25343.2	25344.2	1.0	1.22	1.22	1.22	73.1	116
26-Jul-11	9:00	Sunny	302.1	759.2	3.3706	3.3789	0.0083	25344.2	25345.2	1.0	1.22	1.22	1.22	73.4	113
28-Jul-11	9:00	Sunny	302.6	757.1	3.3556	3.3612	0.0056	25346.2	25347.2	1.0	1.22	1.22	1.22	73.3	76
													Min		64
													Max		134
													Average		95




Appendix D - 1-hour TSP Monitoring Results

Station CAM3

Talcon Industrial Ltd

Date	Sampling Time	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
					Initial	Final		Initial	Final		Initial	Final			
5-Jul-11	16:00	Sunny	305.7	757.3	3.3190	3.3256	0.0066	18502.9	18503.9	1.0	1.20	1.20	1.20	71.9	92
6-Jul-11	13:00	Sunny	302.7	757.1	3.3463	3.3549	0.0086	18503.9	18504.9	1.0	1.20	1.20	1.20	72.2	119
7-Jul-11	16:30	Sunny	302.9	756.5	3.3425	3.3476	0.0051	18528.9	18529.9	1.0	1.20	1.20	1.20	72.1	71
12-Jul-11	9:00	Cloudy	299.4	753.6	3.3342	3.3424	0.0082	18529.9	18530.9	1.0	1.21	1.21	1.21	72.4	113
13-Jul-11	15:00	Cloudy	301.3	753.7	3.3170	3.3255	0.0085	18554.9	18555.9	1.0	1.20	1.20	1.20	72.2	118
14-Jul-11	13:00	Cloudy	300.3	754.5	3.3999	3.4046	0.0047	18555.9	18556.9	1.0	1.21	1.21	1.21	72.3	65
19-Jul-11	13:00	Cloudy	300.9	751.7	3.4293	3.4360	0.0067	18580.9	18581.9	1.0	1.20	1.20	1.20	72.1	93
20-Jul-11	9:00	Cloudy	298.6	754.1	3.3919	3.3985	0.0066	18581.9	18582.9	1.0	1.21	1.21	1.21	72.5	91
21-Jul-11	9:00	Sunny	300.2	756.6	3.4146	3.4195	0.0049	18582.9	18583.9	1.0	1.21	1.21	1.21	72.4	68
25-Jul-11	14:00	Sunny	304.6	756.6	3.4115	3.4192	0.0077	18608.9	18609.9	1.0	1.21	1.21	1.21	72.8	106
26-Jul-11	9:00	Sunny	302.1	759.2	3.3631	3.3719	0.0088	18609.9	18610.9	1.0	1.22	1.22	1.22	73.2	120
28-Jul-11	9:00	Sunny	302.6	757.1	3.3885	3.3943	0.0058	18611.9	18612.9	1.0	1.22	1.22	1.22	73.1	79
														Min	65
														Max	120
														Average	95

1-hr TSP Concentration Levels

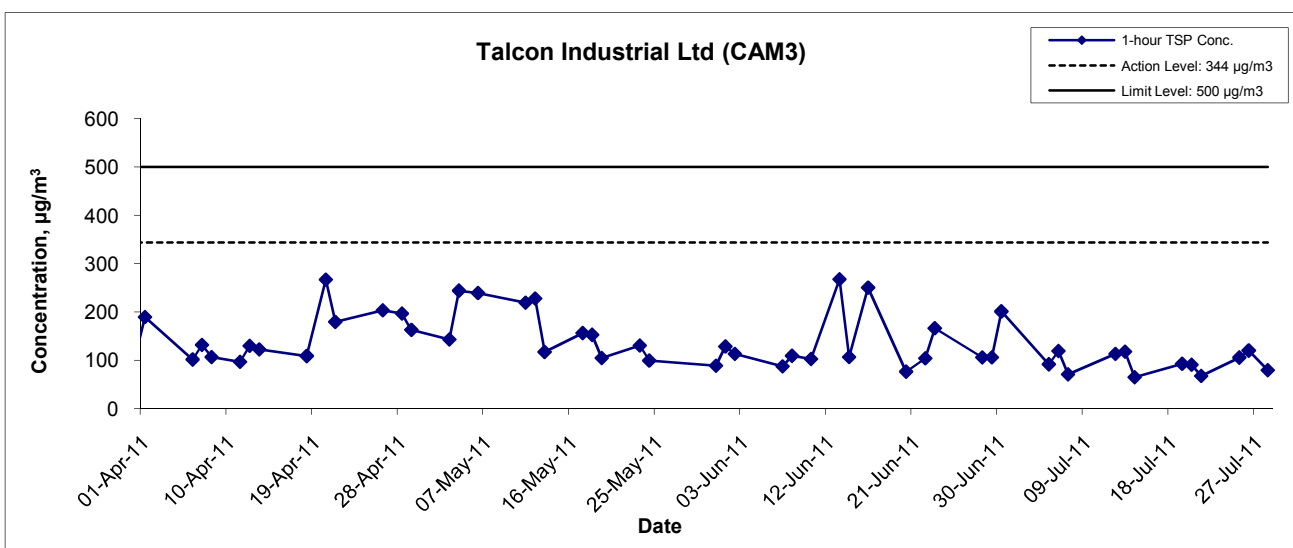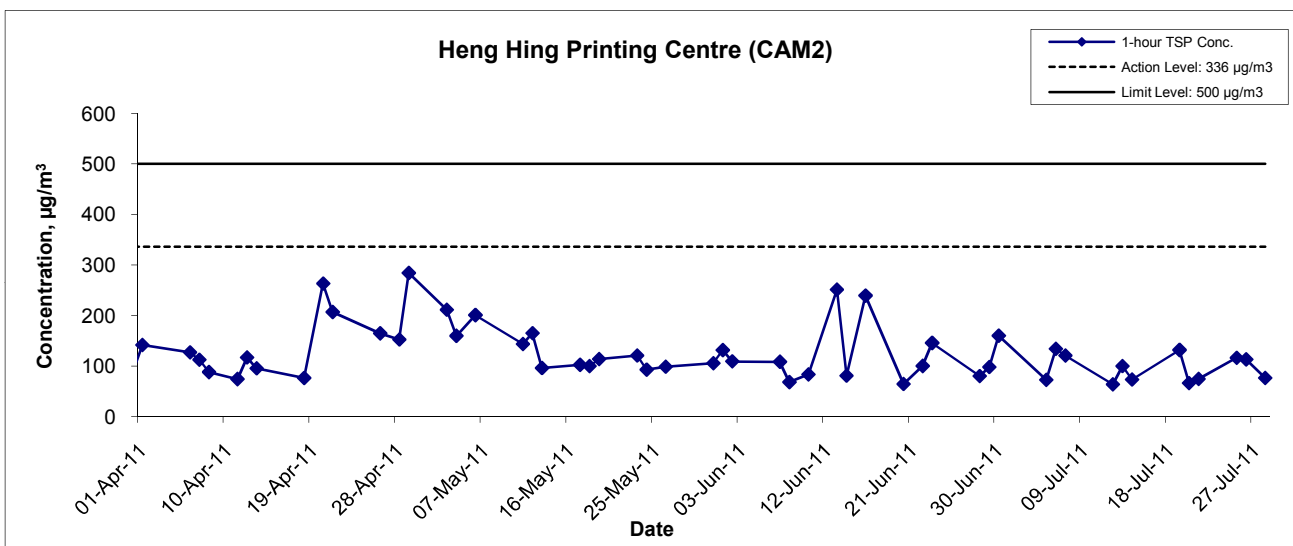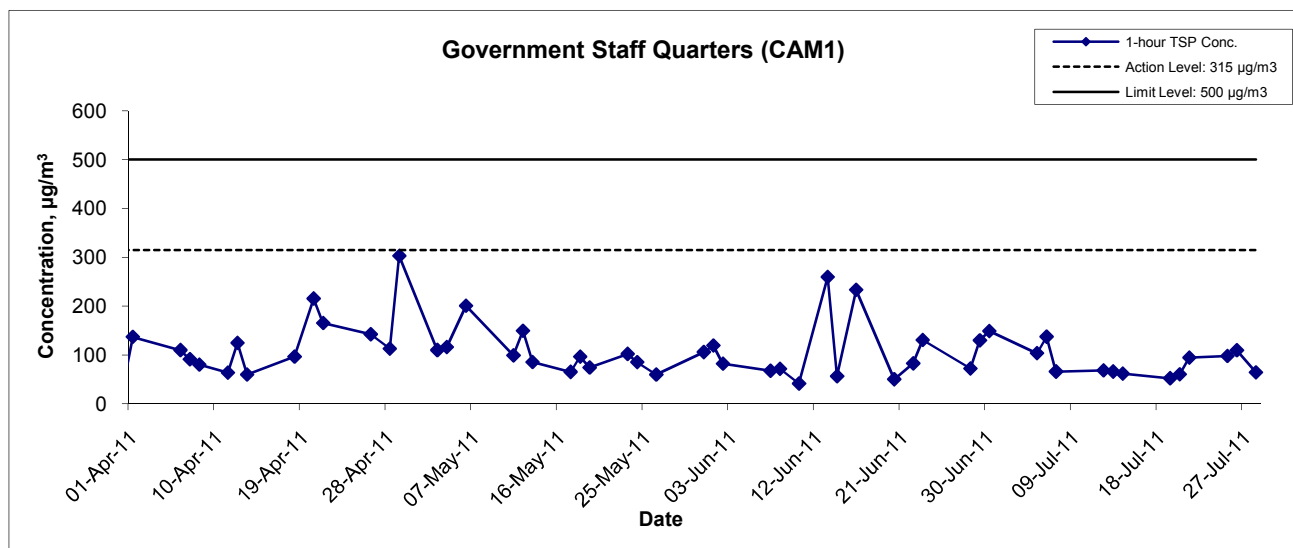

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of 1-hour TSP Impact Monitoring Results	Scale N.T.S	Project No. MA0010	
	Date Jul 11	Appendix D	

**APPENDIX E
24-HOUR TSP MONITORING RESULTS
AND GRAPHICAL PRESENTATION**

Appendix E - 24-hour TSP Monitoring Results

Station CAM1 Government Staff Quarters

Start Date	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
				Initial	Final		Initial	Final		Initial	Final			
6-Jul-11	Sunny	305.3	754.7	3.3653	3.4102	0.0449	16064.1	16088.1	24.0	1.21	1.21	1.21	1739.1	26
12-Jul-11	Cloudy	303.9	755.7	3.3797	3.4782	0.0985	16090.1	16114.1	24.0	1.21	1.21	1.21	1743.7	56
18-Jul-11	Cloudy	301.1	752.9	3.4187	3.4819	0.0632	16116.1	16140.1	24.0	1.21	1.21	1.21	1748.0	36
23-Jul-11	Sunny	301.9	758.7	3.4183	3.4723	0.0540	16143.1	16167.1	24.0	1.22	1.22	1.22	1755.1	31
29-Jul-11	Cloudy	300.3	755.3	3.4057	3.4831	0.0774	16173.1	16197.1	24.0	1.22	1.22	1.22	1755.7	44
													Min	26
													Max	56
													Average	39




Station CAM2 Heng Hing Printing Centre

Start Date	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
				Initial	Final		Initial	Final		Initial	Final			
6-Jul-11	Sunny	305.3	754.7	3.3071	3.3617	0.0546	25241.2	25265.2	24.0	1.20	1.20	1.20	1723.2	32
12-Jul-11	Cloudy	303.9	755.7	3.3936	3.4905	0.0969	25265.2	25289.2	24.0	1.20	1.20	1.20	1727.7	56
18-Jul-11	Cloudy	301.1	752.9	3.4003	3.5080	0.1077	25291.2	25315.2	24.0	1.20	1.20	1.20	1731.9	62
23-Jul-11	Sunny	301.9	758.7	3.4182	3.4794	0.0612	25318.2	25342.2	24.0	1.22	1.22	1.22	1762.5	35
29-Jul-11	Cloudy	300.3	755.3	3.4057	3.5031	0.0974	25348.2	25372.2	24.0	1.22	1.22	1.22	1763.2	55
													Min	32
													Max	62
													Average	48

Station CAM3 Talcon Industrial Ltd

Start Date	Weather Condition	Air Temp. (K)	Atmospheric Pressure (Pa)	Filter Weight (g)		Particulate weight (g)	Elapse Time		Sampling Time(hrs.)	Flow Rate (m ³ /min.)		Av. flow (m ³ /min)	Total vol. (m ³)	Conc. (µg/m ³)
				Initial	Final		Initial	Final		Initial	Final			
6-Jul-11	Sunny	305.3	754.7	3.3709	3.4410	0.0701	18504.9	18528.9	24.0	1.20	1.20	1.20	1723.4	41
12-Jul-11	Cloudy	303.9	755.7	3.3715	3.4598	0.0883	18530.9	18554.9	24.0	1.20	1.20	1.20	1727.9	51
18-Jul-11	Cloudy	301.1	752.9	3.4104	3.5569	0.1465	18556.9	18580.9	24.0	1.20	1.20	1.20	1732.0	85
23-Jul-11	Sunny	301.9	758.7	3.4138	3.4888	0.0750	18583.9	18607.9	24.0	1.22	1.22	1.22	1756.7	43
29-Jul-11	Cloudy	300.3	755.3	3.4057	3.5056	0.0999	18613.9	18637.9	24.0	1.22	1.22	1.22	1757.3	57
													Min	41
													Max	85
													Average	55

24-hr TSP Concentration Levels

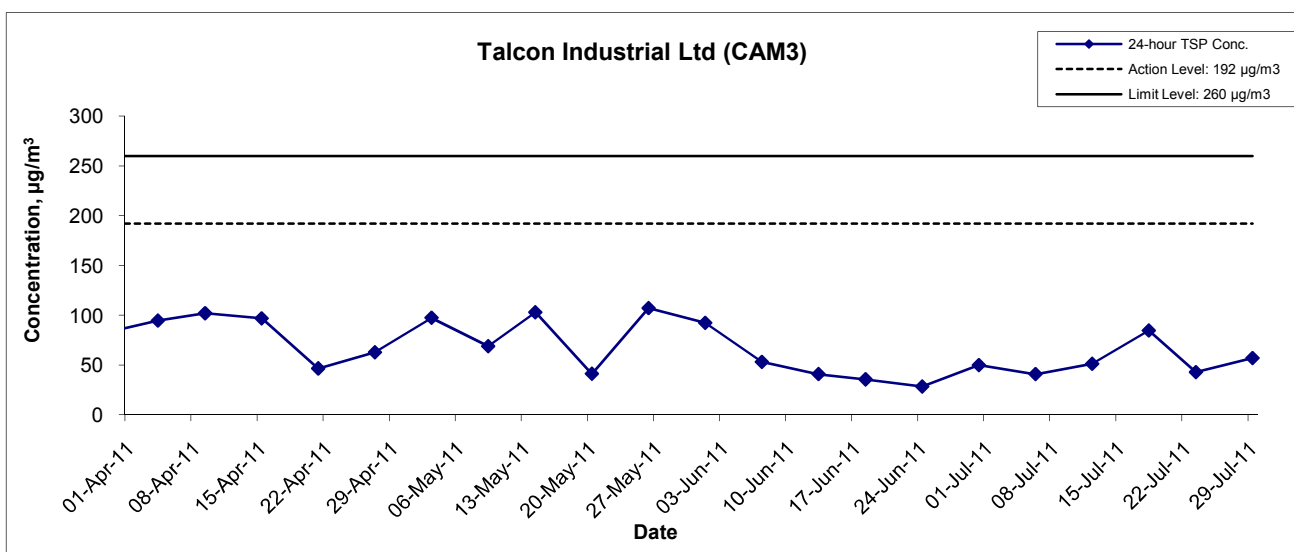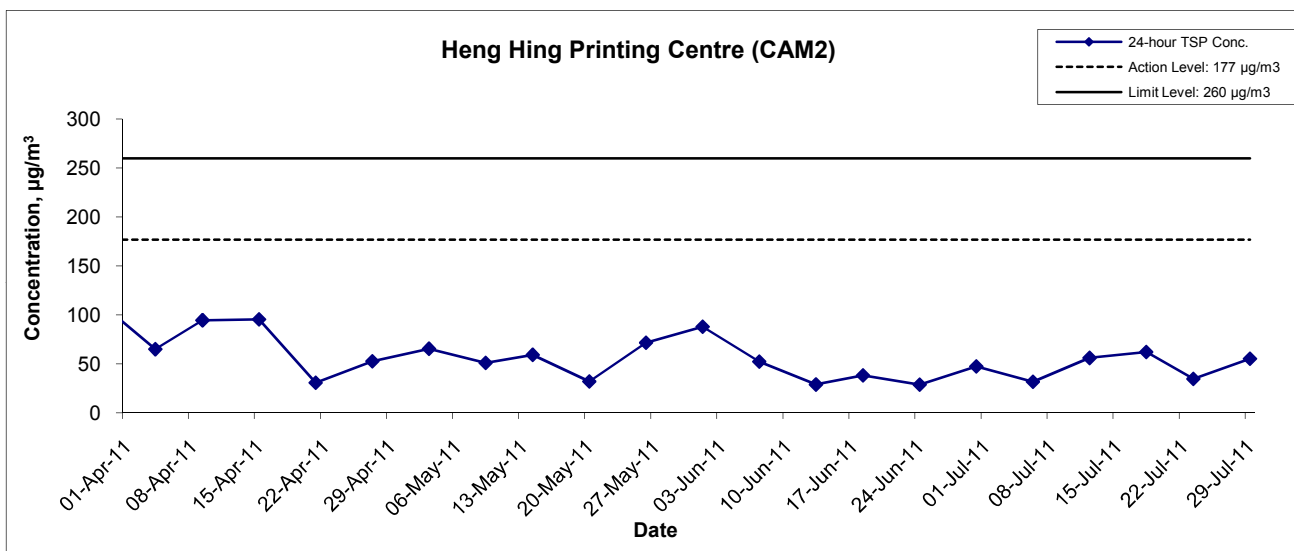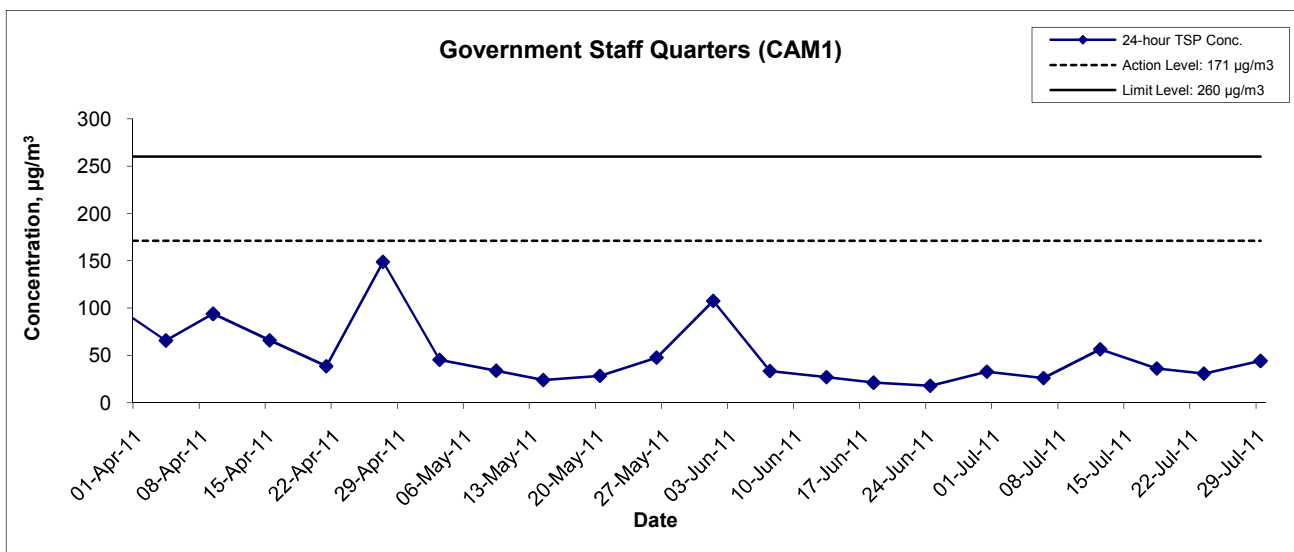


Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of 24-hour TSP Impact Monitoring Results	Scale N.T.S	Project No. MA0010	
	Date Jul 11	Appendix E	

**APPENDIX F
NOISE MONITORING RESULTS AND
GRAPHICAL PRESENTATION**

Appendix F - Noise Monitoring Results

Location NM1 - Government Staff Quarters					
Date	Time	Weather	dB (A) (30-min)		
			L _{eq}	L ₁₀	L ₉₀
7-Jul-11	13:35	Fine	60.7	63.2	56.4
12-Jul-11	13:00	Fine	59.9	62.1	55.8
21-Jul-11	11:00	Fine	60.8	62.7	55.9
27-Jul-11	14:30	Fine	60.2	63.7	56.6
		Average	60.4	62.9	56.2
		Minimum	59.9	62.1	55.8
		Maximum	60.8	63.7	56.6

Noise Levels

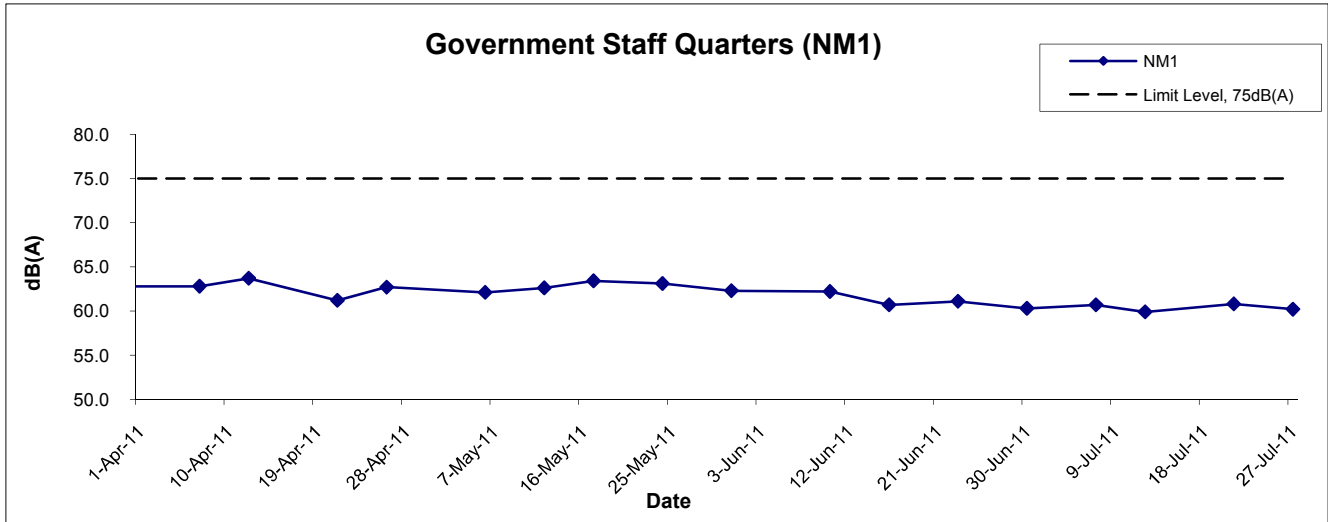

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of Construction Noise Monitoring Results	Scale N.T.S	Project No. MA0010	
	Date Jul 11	Appendix F	

**APPENDIX G
RECORDS OF LANDFILL GAS
MEASUREMENT BY THE
CONTRACTOR**

APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
FC7B	2-Jul-11	8:30 AM	79.1	0	0	20.9
	2-Jul-11	1:30 PM	79.1	0	0	20.9
	4-Jul-11	8:30 AM	79.1	0	0	20.9
	4-Jul-11	1:30 PM	79.1	0	0	20.9
	5-Jul-11	8:30 AM	79.1	0	0	20.9
	5-Jul-11	1:30 PM	79.1	0	0	20.9
	6-Jul-11	8:30 AM	79.1	0	0	20.9
	6-Jul-11	1:30 PM	79.1	0	0	20.9
	7-Jul-11	8:30 AM	79.1	0	0	20.9
	7-Jul-11	1:30 PM	79.1	0	0	20.9
	8-Jul-11	8:30 AM	79.1	0	0	20.9
	8-Jul-11	1:30 PM	79.1	0	0	20.9
	9-Jul-11	8:30 AM	79.1	0	0	20.9
	9-Jul-11	1:30 PM	79.1	0	0	20.9
	11-Jul-11	8:30 AM	79.1	0	0	20.9
	11-Jul-11	1:30 PM	79.1	0	0	20.9
	12-Jul-11	8:30 AM	79.1	0	0	20.9
	12-Jul-11	1:30 PM	79.1	0	0	20.9
	13-Jul-11	8:30 AM	79.1	0	0	20.9
	13-Jul-11	1:30 PM	79.1	0	0	20.9
	14-Jul-11	8:30 AM	79.1	0	0	20.9
	14-Jul-11	1:30 PM	79.1	0	0	20.9
	15-Jul-11	8:30 AM	79.1	0	0	20.9
	15-Jul-11	1:30 PM	79.1	0	0	20.9
	18-Jul-11	8:30 AM	79.1	0	0	20.9
	18-Jul-11	1:30 PM	79.1	0	0	20.9
	19-Jul-11	8:30 AM	79.1	0	0	20.9
	19-Jul-11	1:30 PM	79.1	0	0	20.9
	20-Jul-11	8:30 AM	79.1	0	0	20.9
	20-Jul-11	1:30 PM	79.1	0	0	20.9
	21-Jul-11	8:30 AM	79.1	0	0	20.9
	21-Jul-11	1:30 PM	79.1	0	0	20.9
	22-Jul-11	8:30 AM	79.1	0	0	20.9
	22-Jul-11	1:30 PM	79.1	0	0	20.9
	23-Jul-11	8:30 AM	79.1	0	0	20.9
	23-Jul-11	1:30 PM	79.1	0	0	20.9
	25-Jul-11	8:30 AM	79.1	0	0	20.9
	25-Jul-11	1:30 PM	79.1	0	0	20.9
	26-Jul-11	8:30 AM	79.1	0	0	20.9
	26-Jul-11	1:30 PM	79.1	0	0	20.9
	27-Jul-11	8:30 AM	79.1	0	0	20.9
	27-Jul-11	1:30 PM	79.1	0	0	20.9
	28-Jul-11	8:30 AM	79.1	0	0	20.9
	28-Jul-11	1:30 PM	79.1	0	0	20.9
	29-Jul-11	8:30 AM	79.1	0	0	20.9
	29-Jul-11	1:30 PM	79.1	0	0	20.9
	30-Jul-11	8:30 AM	79.1	0	0	20.9
	30-Jul-11	1:30 PM	79.1	0	0	20.9

APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
FC8B	2-Jul-11	8:15 AM	79.1	0	0	20.9
	2-Jul-11	1:15 PM	79.1	0	0	20.9
	4-Jul-11	8:15 AM	79.1	0	0	20.9
	4-Jul-11	1:15 PM	79.1	0	0	20.9
	5-Jul-11	8:15 AM	79.1	0	0	20.9
	5-Jul-11	1:15 PM	79.1	0	0	20.9
	6-Jul-11	8:15 AM	79.1	0	0	20.9
	6-Jul-11	1:15 PM	79.1	0	0	20.9
	7-Jul-11	8:15 AM	79.1	0	0	20.9
	7-Jul-11	1:15 PM	79.1	0	0	20.9
	8-Jul-11	8:15 AM	79.1	0	0	20.9
	8-Jul-11	1:15 PM	79.1	0	0	20.9
	9-Jul-11	8:15 AM	79.1	0	0	20.9
	9-Jul-11	1:15 PM	79.1	0	0	20.9
	11-Jul-11	8:15 AM	79.1	0	0	20.9
	11-Jul-11	1:15 PM	79.1	0	0	20.9
	12-Jul-11	8:15 AM	79.1	0	0	20.9
	12-Jul-11	1:15 PM	79.1	0	0	20.9
	13-Jul-11	8:15 AM	79.1	0	0	20.9
	13-Jul-11	1:15 PM	79.1	0	0	20.9
	14-Jul-11	8:15 AM	79.1	0	0	20.9
	14-Jul-11	1:15 PM	79.1	0	0	20.9
	15-Jul-11	8:15 AM	79.1	0	0	20.9
	15-Jul-11	1:15 PM	79.1	0	0	20.9
	16-Jul-11	8:15 AM	79.1	0	0	20.9
	16-Jul-11	1:15 PM	79.1	0	0	20.9
	18-Jul-11	8:15 AM	79.1	0	0	20.9
	18-Jul-11	1:15 PM	79.1	0	0	20.9
	19-Jul-11	8:15 AM	79.1	0	0	20.9
	19-Jul-11	1:15 PM	79.1	0	0	20.9
20-Jul-11	8:15 AM	79.1	0	0	20.9	
20-Jul-11	1:15 PM	79.1	0	0	20.9	
21-Jul-11	8:15 AM	79.1	0	0	20.9	
21-Jul-11	1:15 PM	79.1	0	0	20.9	
22-Jul-11	8:15 AM	79.1	0	0	20.9	
22-Jul-11	1:15 PM	79.1	0	0	20.9	
23-Jul-11	8:15 AM	79.1	0	0	20.9	
23-Jul-11	1:15 PM	79.1	0	0	20.9	
24-Jul-11	8:15 AM	79.1	0	0	20.9	
24-Jul-11	1:15 PM	79.1	0	0	20.9	
25-Jul-11	8:15 AM	79.1	0	0	20.9	
25-Jul-11	1:15 PM	79.1	0	0	20.9	
26-Jul-11	8:15 AM	79.1	0	0	20.9	
26-Jul-11	1:15 PM	79.1	0	0	20.9	
27-Jul-11	8:15 AM	79.1	0	0	20.9	
27-Jul-11	1:15 PM	79.1	0	0	20.9	
28-Jul-11	8:15 AM	79.1	0	0	20.9	
28-Jul-11	1:15 PM	79.1	0	0	20.9	
29-Jul-11	8:15 AM	79.1	0	0	20.9	
29-Jul-11	1:15 PM	79.1	0	0	20.9	
30-Jul-11	8:15 AM	79.1	0	0	20.9	
30-Jul-11	1:15 PM	79.1	0	0	20.9	





APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
Aeration Tank	2-Jul-11	8:00 AM	79.1	0	0	20.9
	2-Jul-11	1:00 PM	79.1	0	0	20.9
	4-Jul-11	8:00 AM	79.1	0	0	20.9
	4-Jul-11	1:00 PM	79.1	0	0	20.9
	5-Jul-11	8:00 AM	79.1	0	0	20.9
	5-Jul-11	1:00 PM	79.1	0	0	20.9
	6-Jul-11	8:00 AM	79.1	0	0	20.9
	6-Jul-11	1:00 PM	79.1	0	0	20.9
	7-Jul-11	8:00 AM	79.1	0	0	20.9
	7-Jul-11	1:00 PM	79.1	0	0	20.9
	8-Jul-11	8:00 AM	79.1	0	0	20.9
	8-Jul-11	1:00 PM	79.1	0	0	20.9
	9-Jul-11	8:00 AM	79.1	0	0	20.9
	9-Jul-11	1:00 PM	79.1	0	0	20.9
	11-Jul-11	8:00 AM	79.1	0	0	20.9
	11-Jul-11	1:00 PM	79.1	0	0	20.9
	12-Jul-11	8:00 AM	79.1	0	0	20.9
	12-Jul-11	1:00 PM	79.1	0	0	20.9
	13-Jul-11	8:00 AM	79.1	0	0	20.9
	13-Jul-11	1:00 PM	79.1	0	0	20.9
	14-Jul-11	8:00 AM	79.1	0	0	20.9
	14-Jul-11	1:00 PM	79.1	0	0	20.9
	15-Jul-11	8:00 AM	79.1	0	0	20.9
	15-Jul-11	1:00 PM	79.1	0	0	20.9
	16-Jul-11	8:00 AM	79.1	0	0	20.9
	16-Jul-11	1:00 PM	79.1	0	0	20.9
	18-Jul-11	8:00 AM	79.1	0	0	20.9
	18-Jul-11	1:00 PM	79.1	0	0	20.9
	19-Jul-11	8:00 AM	79.1	0	0	20.9
	19-Jul-11	1:00 PM	79.1	0	0	20.9
20-Jul-11	8:00 AM	79.1	0	0	20.9	
20-Jul-11	1:00 PM	79.1	0	0	20.9	
21-Jul-11	8:00 AM	79.1	0	0	20.9	
21-Jul-11	1:00 PM	79.1	0	0	20.9	
22-Jul-11	8:00 AM	79.1	0	0	20.9	
22-Jul-11	1:00 PM	79.1	0	0	20.9	
23-Jul-11	8:00 AM	79.1	0	0	20.9	
23-Jul-11	1:00 PM	79.1	0	0	20.9	
24-Jul-11	8:00 AM	79.1	0	0	20.9	
24-Jul-11	1:00 PM	79.1	0	0	20.9	
25-Jul-11	8:00 AM	79.1	0	0	20.9	
25-Jul-11	1:00 PM	79.1	0	0	20.9	
26-Jul-11	8:00 AM	79.1	0	0	20.9	
26-Jul-11	1:00 PM	79.1	0	0	20.9	
27-Jul-11	8:00 AM	79.1	0	0	20.9	
27-Jul-11	1:00 PM	79.1	0	0	20.9	
28-Jul-11	8:00 AM	79.1	0	0	20.9	
28-Jul-11	1:00 PM	79.1	0	0	20.9	
29-Jul-11	8:00 AM	79.1	0	0	20.9	
29-Jul-11	1:00 PM	79.1	0	0	20.9	
30-Jul-11	8:00 AM	79.1	0	0	20.9	
30-Jul-11	1:00 PM	79.1	0	0	20.9	

APPENDIX G - RECORDS OF LANDFILL GAS MEASUREMENT BY THE CONTRACTOR

Location	Date of Measurement	Sampling time	Balance gas (%)	Combustible Gas (Methane) (% LEL)	Carbon dioxide (%)	Oxygen (%)
DN1500 Airmain	2-Jul-11	8:45 AM	79.1	0	0	20.9
	2-Jul-11	1:45 PM	79.1	0	0	20.9
	4-Jul-11	8:45 AM	79.1	0	0	20.9
	4-Jul-11	1:45 PM	79.1	0	0	20.9
	5-Jul-11	8:45 AM	79.1	0	0	20.9
	5-Jul-11	1:45 PM	79.1	0	0	20.9
	6-Jul-11	8:45 AM	79.1	0	0	20.9
	6-Jul-11	1:45 PM	79.1	0	0	20.9
	7-Jul-11	8:45 AM	79.1	0	0	20.9
	7-Jul-11	1:45 PM	79.1	0	0	20.9
	8-Jul-11	8:45 AM	79.1	0	0	20.9
	8-Jul-11	1:45 PM	79.1	0	0	20.9
	9-Jul-11	8:45 AM	79.1	0	0	20.9
	9-Jul-11	1:45 PM	79.1	0	0	20.9
	11-Jul-11	8:45 AM	79.1	0	0	20.9
	11-Jul-11	1:45 PM	79.1	0	0	20.9
	12-Jul-11	8:45 AM	79.1	0	0	20.9
	12-Jul-11	1:45 PM	79.1	0	0	20.9
	13-Jul-11	8:45 AM	79.1	0	0	20.9
	13-Jul-11	1:45 PM	79.1	0	0	20.9
	14-Jul-11	8:45 AM	79.1	0	0	20.9
	14-Jul-11	1:45 PM	79.1	0	0	20.9
	15-Jul-11	8:45 AM	79.1	0	0	20.9
	15-Jul-11	1:45 PM	79.1	0	0	20.9
	16-Jul-11	8:45 AM	79.1	0	0	20.9
	16-Jul-11	1:45 PM	79.1	0	0	20.9
	18-Jul-11	8:45 AM	79.1	0	0	20.9
	18-Jul-11	1:45 PM	79.1	0	0	20.9
	19-Jul-11	8:45 AM	79.1	0	0	20.9
	19-Jul-11	1:45 PM	79.1	0	0	20.9
20-Jul-11	8:45 AM	79.1	0	0	20.9	
20-Jul-11	1:45 PM	79.1	0	0	20.9	
21-Jul-11	8:45 AM	79.1	0	0	20.9	
21-Jul-11	1:45 PM	79.1	0	0	20.9	
22-Jul-11	8:45 AM	79.1	0	0	20.9	
22-Jul-11	1:45 PM	79.1	0	0	20.9	
23-Jul-11	8:45 AM	79.1	0	0	20.9	
23-Jul-11	1:45 PM	79.1	0	0	20.9	
24-Jul-11	8:45 AM	79.1	0	0	20.9	
24-Jul-11	1:45 PM	79.1	0	0	20.9	
25-Jul-11	8:45 AM	79.1	0	0	20.9	
25-Jul-11	1:45 PM	79.1	0	0	20.9	
26-Jul-11	8:45 AM	79.1	0	0	20.9	
26-Jul-11	1:45 PM	79.1	0	0	20.9	
27-Jul-11	8:45 AM	79.1	0	0	20.9	
27-Jul-11	1:45 PM	79.1	0	0	20.9	
28-Jul-11	8:45 AM	79.1	0	0	20.9	
28-Jul-11	1:45 PM	79.1	0	0	20.9	
29-Jul-11	8:45 AM	79.1	0	0	20.9	
29-Jul-11	1:45 PM	79.1	0	0	20.9	
30-Jul-11	8:45 AM	79.1	0	0	20.9	
30-Jul-11	1:45 PM	79.1	0	0	20.9	

Balance Gas

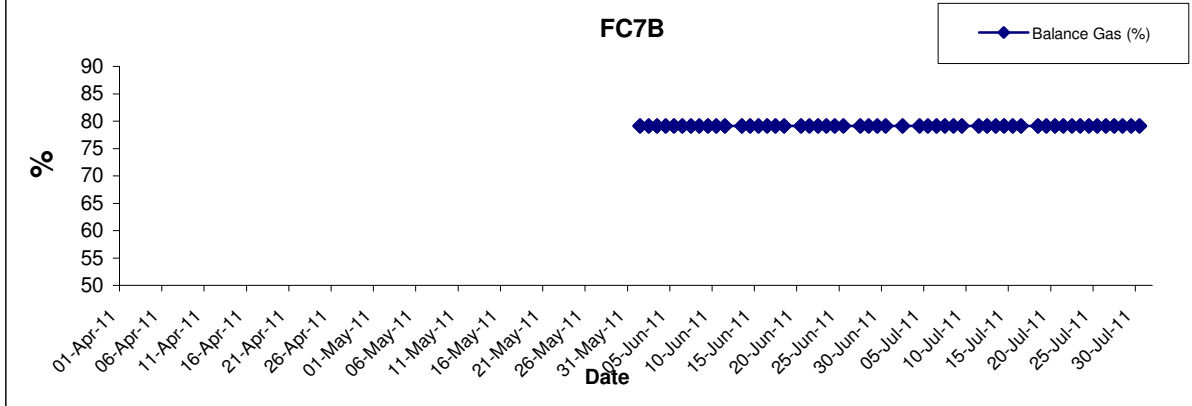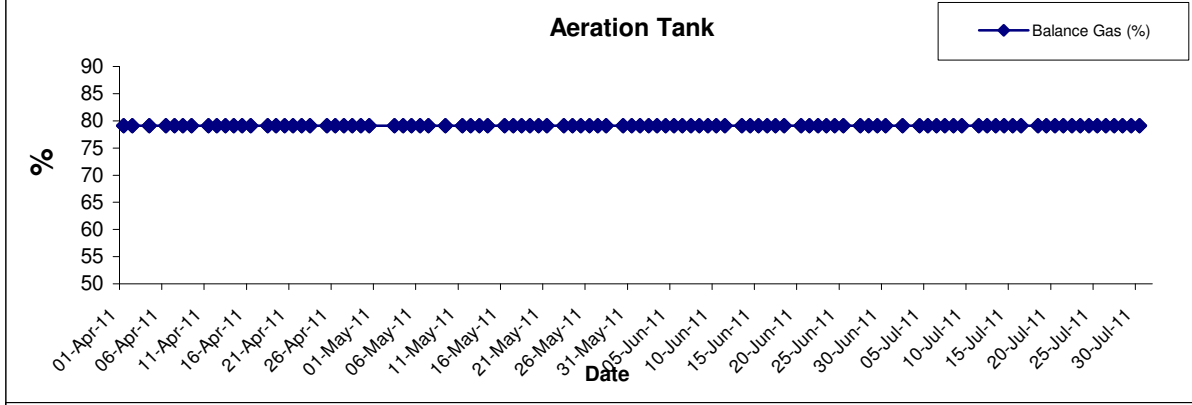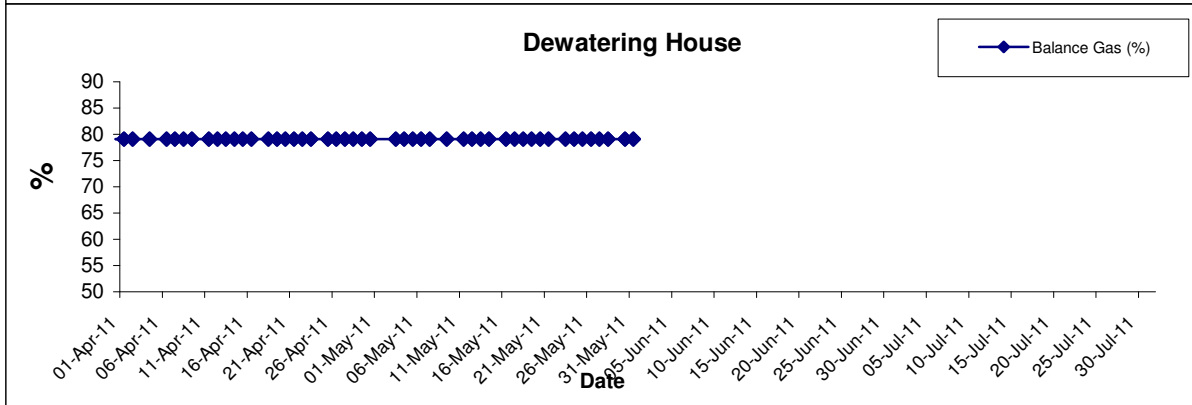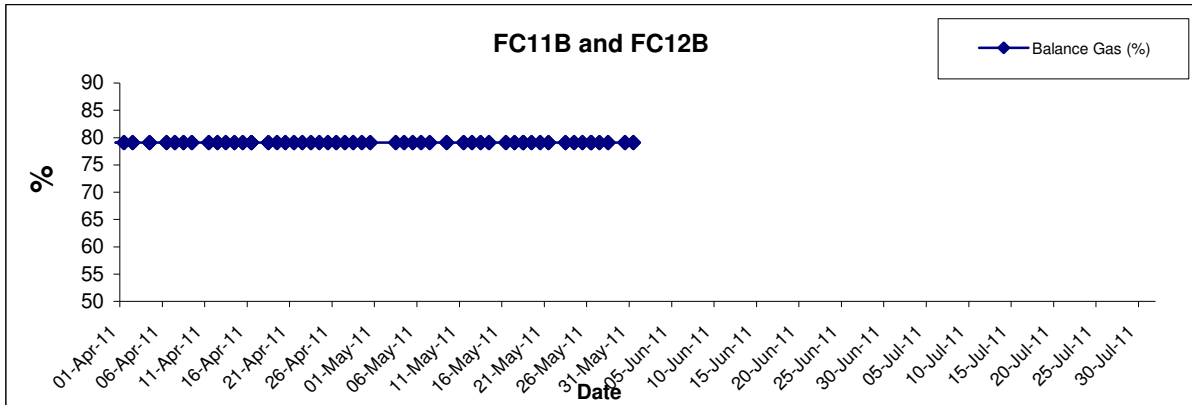



Title Contract No. DC/2009/09
 Construction of Tai Po Sewage Treatment Works - Stage V
 Phase II B
 Graphical Presentation of Landfill Gas Measurement

Scale N.T.S
 Date July 11

Project No. MA0010
 Appendix G




Balance Gas

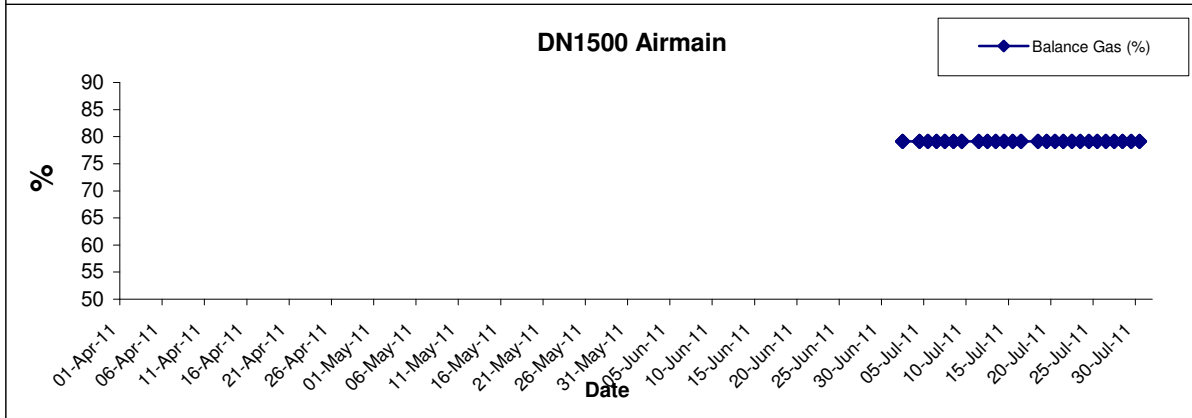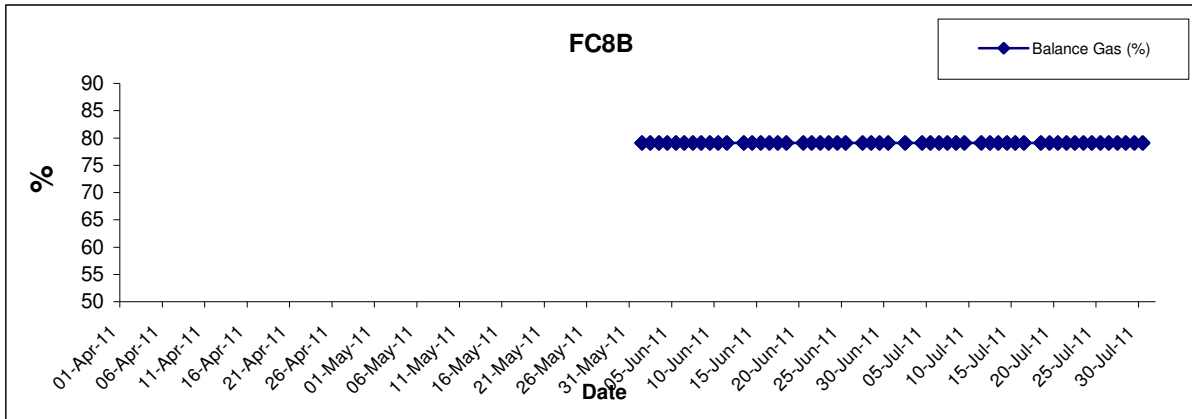

Title	Contract No. DC/2009/09	Scale	Project	CINOTECH
	Construction of Tai Po Sewage Treatment Works - Stage V Phase II B	N.T.S	No. MA0010	
Graphical Presentation of Landfill Gas Measurement	Date	July 11	Appendix G	

Combustible Gas (Methane)

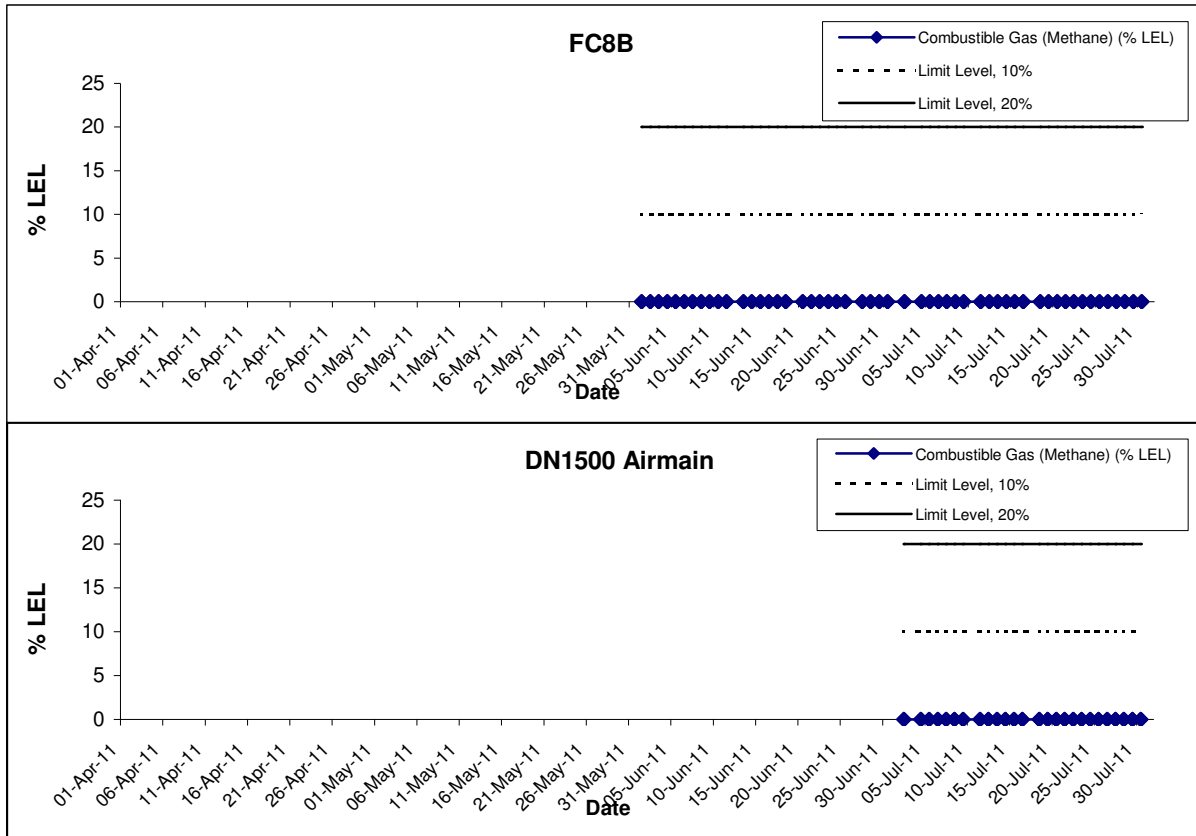





Title
 Contract No. DC/2009/09
 Construction of Tai Po Sewage Treatment Works - Stage V
 Phase II B
 Graphical Presentation of Landfill Gas Measurement

Scale
 N.T.S
 Date
 July 11

Project
 No. MA0010
 Appendix
 G



Carbon Dioxide

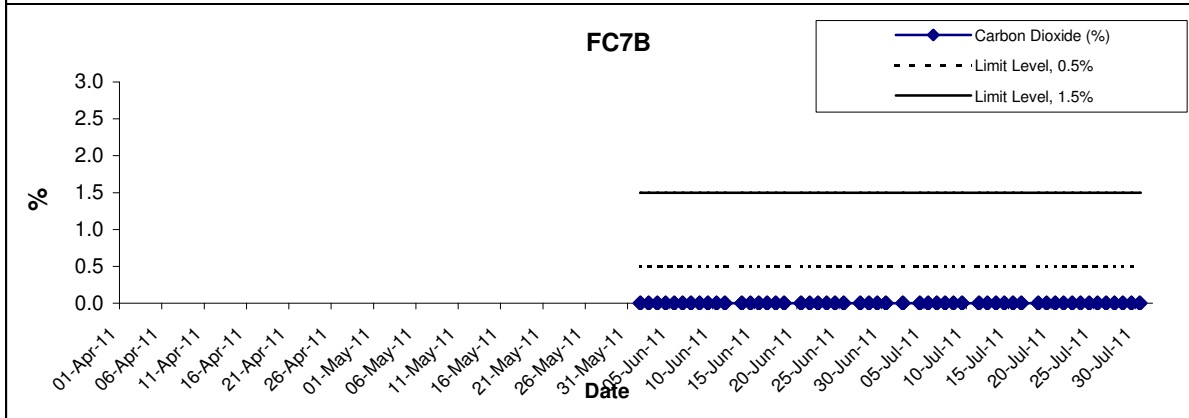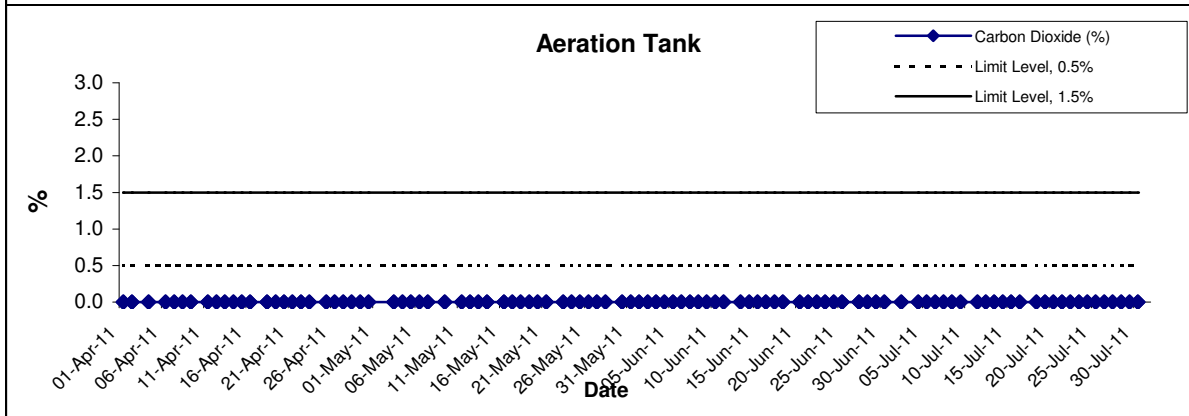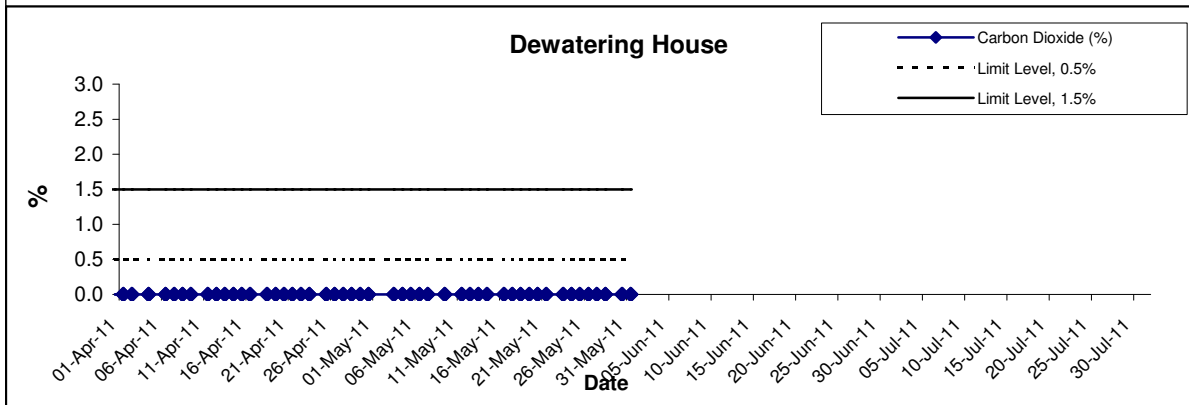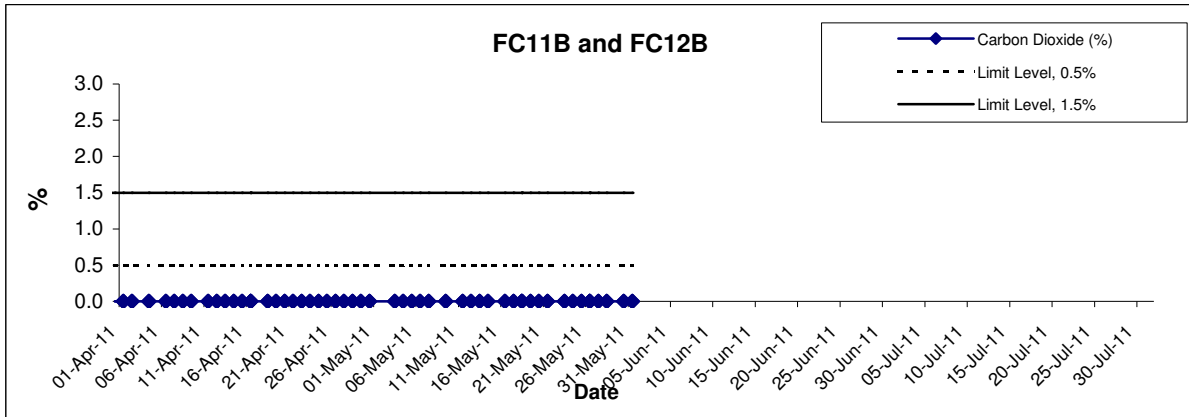


Title Contract No. DC/2009/09
 Construction of Tai Po Sewage Treatment Works - Stage V
 Phase II B
 Graphical Presentation of Landfill Gas Measurement

Scale N.T.S
 Date July 11

Project No. MA0010
 Appendix G



Carbon Dioxide

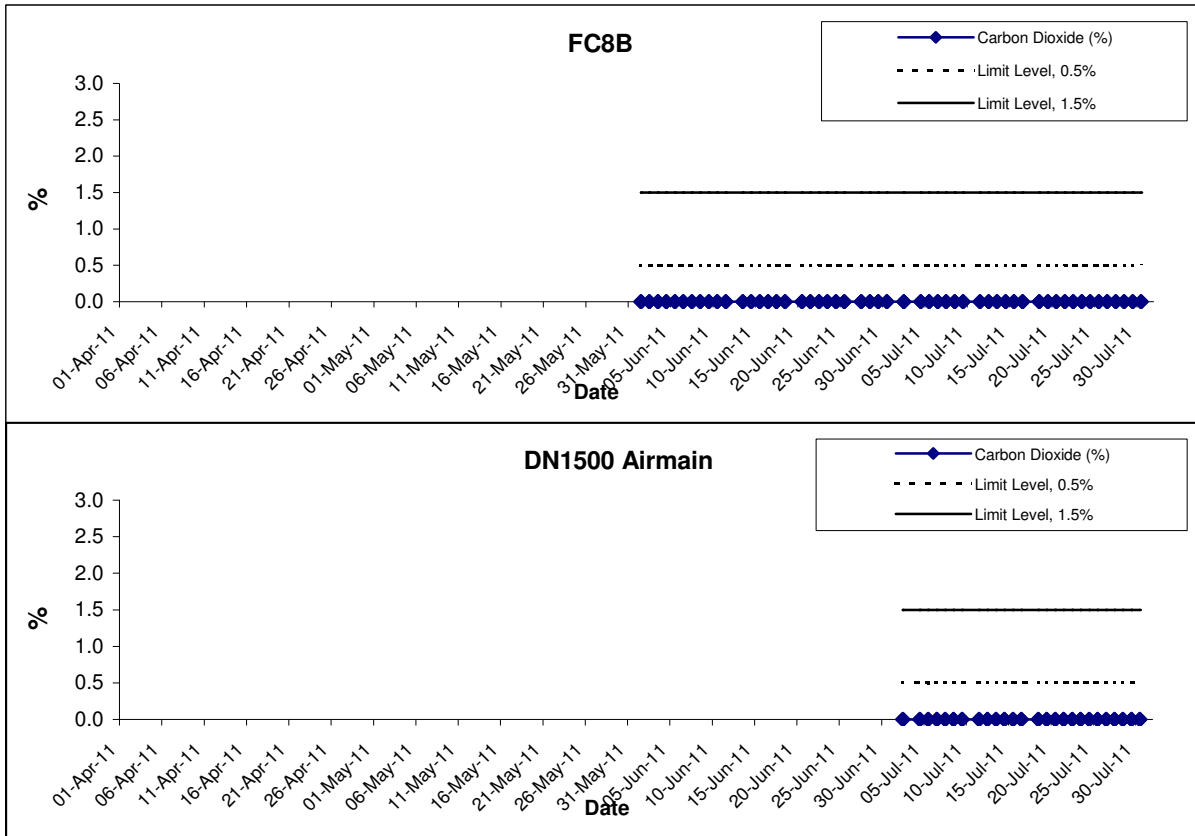





Title Contract No. DC/2009/09
 Construction of Tai Po Sewage Treatment Works - Stage V
 Phase II B
 Graphical Presentation of Landfill Gas Measurement

Scale N.T.S
 Date July 11

Project No. MA0010
 Appendix G



Oxygen

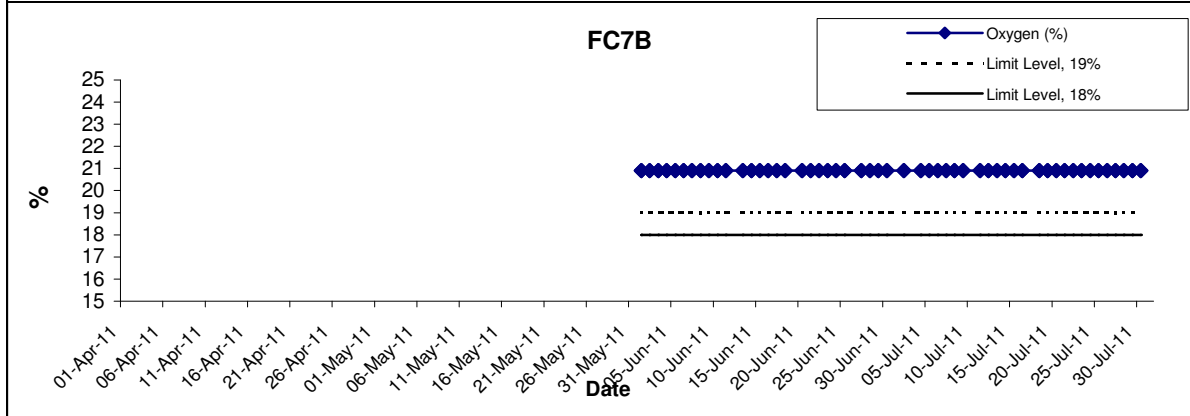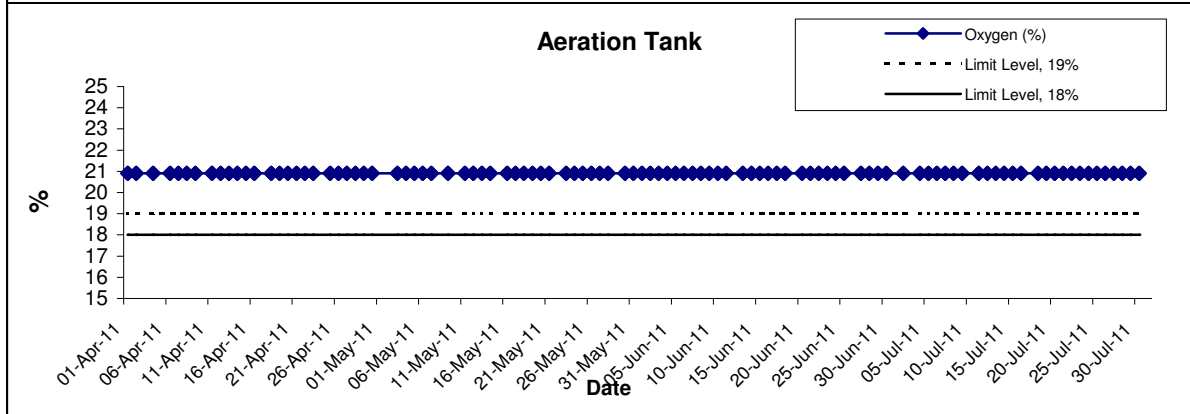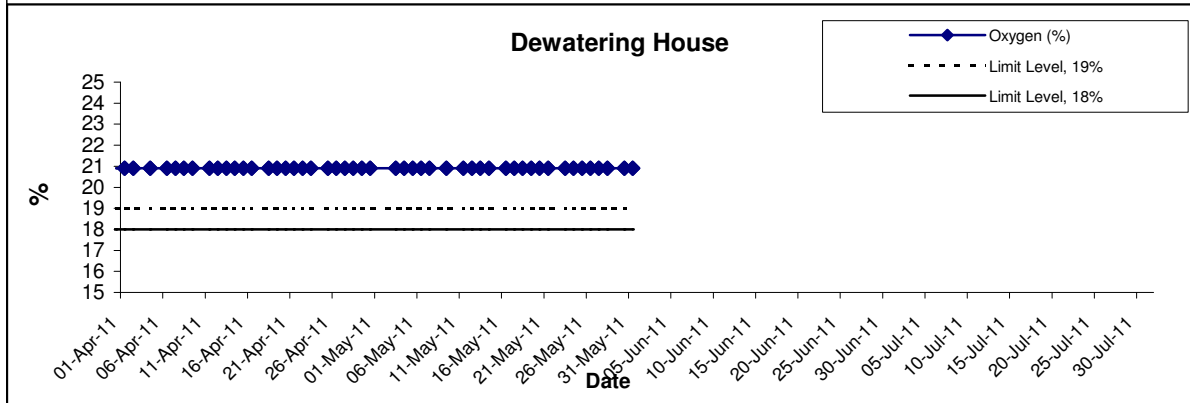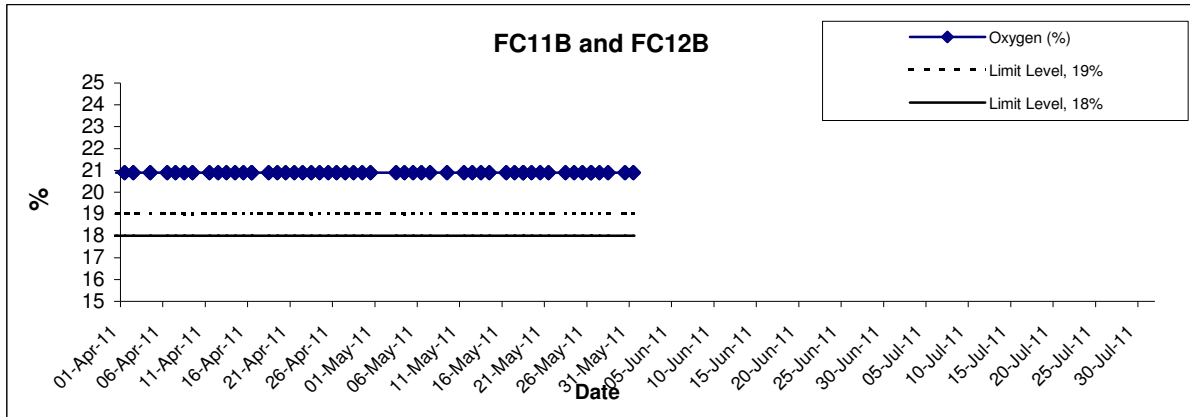



Title Contract No. DC/2009/09
 Construction of Tai Po Sewage Treatment Works - Stage V
 Phase II B
 Graphical Presentation of Landfill Gas Measurement

Scale N.T.S
 Date July 11

Project No. MA0010
 Appendix G



Carbon Dioxide

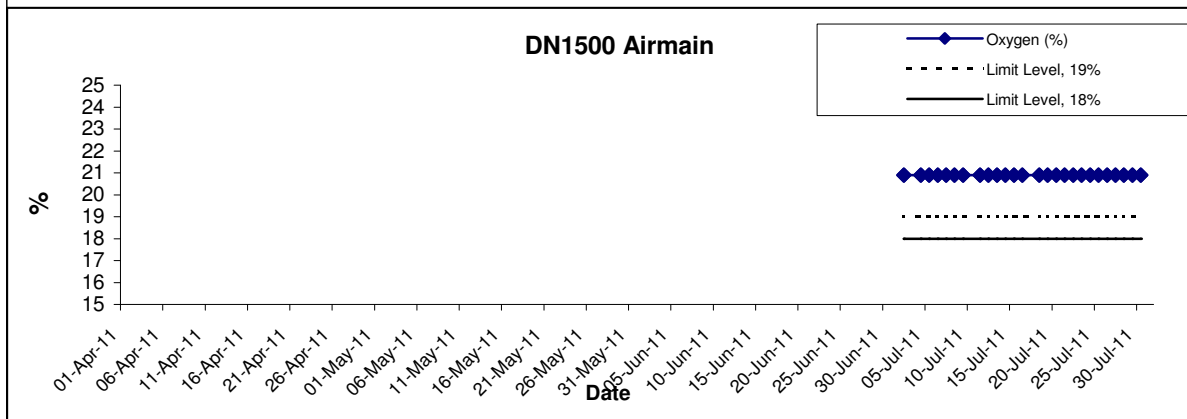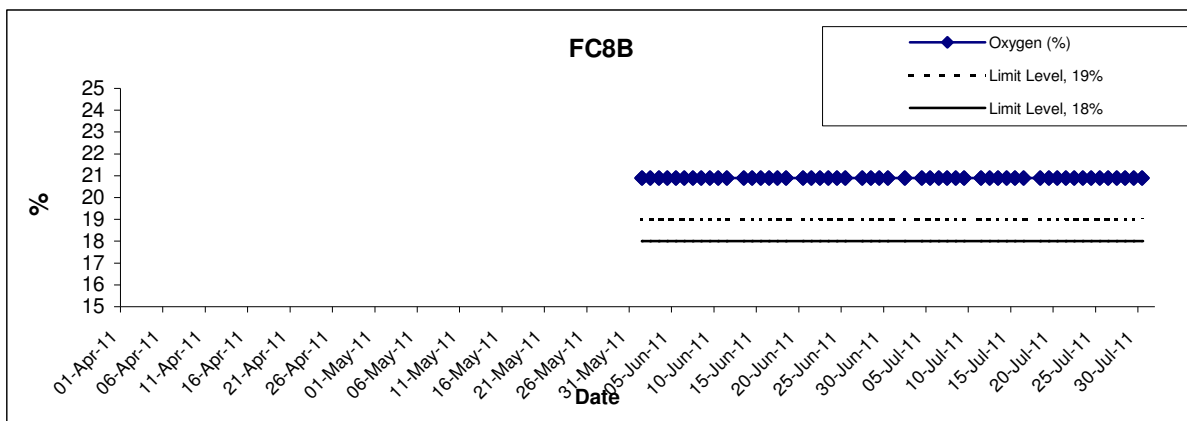

Title Contract No. DC/2009/09 Construction of Tai Po Sewage Treatment Works - Stage V Phase II B Graphical Presentation of Landfill Gas Measurement	Scale N.T.S	Project No. MA0010	CINOTECH
	Date July 11	Appendix G	

APPENDIX H
SUMMARY OF EXCEEDANCE

APPENIDX H – SUMMARY OF EXCEEDANCE

Reporting Month: July 2011

- a) Exceedance Report for 1-hr TSP (NIL)*
- b) Exceedance Report for 24-hr TSP (NIL)*
- c) Exceedance Report for Construction Noise (NIL)*
- d) Exceedance Report for Landfill Gas (NIL)*

**APPENDIX I
SITE AUDIT SUMMARY**



Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	110708
Date	8 th July 2011 (Friday)
Time	09:30-10:30

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>Part B - Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part C - Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part D - Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part E - Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part F - Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part G - Reminder</p> <ul style="list-style-type: none"> The deposited mud should be cleared at wheel washing facility outside the site office. 	B14iii.
110708-R02	<ul style="list-style-type: none"> The Contractor was reminded to keep watering at A-Tank haul road, to avoid dust generation. 	C5
110708-R03	<ul style="list-style-type: none"> The stagnant water should be cleared at FC7B. 	B12
	<p>Others</p> <ul style="list-style-type: none"> Follow-up on the previous audit sessions (Ref. No.110630), all environmental deficiencies were improved/ rectified by the Contractor. 	

	Name	Signature	Date
Recorded by	TY Yeung		8 July 2011
Checked by	Dr. Priscilla Choy		8 July 2011



Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	110714
Date	14 th July 2011 (Thursday)
Time	10:05-10:59

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>Part B - Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part C - Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part D - Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part E - Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part F - Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part G - Reminder</p> <ul style="list-style-type: none"> Sand, silt and mud deposited should be cleaned along the channel opposite to Detritor. 	
110714-R01	<ul style="list-style-type: none"> Construction materials should be disposed of or stored properly at FC8B. 	B7
110714-R02	<ul style="list-style-type: none"> Construction materials should be disposed of or stored properly at FC8B. 	E4ii
	<p>Others</p> <ul style="list-style-type: none"> Follow-up on the previous audit sessions (Ref. No.110714), all environmental deficiencies were improved/ rectified by the Contractor. 	

	Name	Signature	Date
Recorded by	William Lai		18 July 2011
Checked by	Dr. Priscilla Choy		18 July 2011



Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	110721
Date	21 st July 2011 (Thursday)
Time	10:00-11:15

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
110721-001	<p>Part B - Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part C - Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part D - Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. <p>Part E - Waste / Chemical Management</p> <ul style="list-style-type: none"> The deposited silt and mud was observed to be disposed along the haul road at FC11B&12B. The Contractor was reminded to clear the deposited silt, to avoid directing to the public during rain. <p>Part F - Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	E6
110721-R02	<p>Part G - Reminder</p> <ul style="list-style-type: none"> The general refuse with the rubbish bin should be cleared at FC11B&12B. <p>Others</p> <ul style="list-style-type: none"> Follow-up on the previous audit sessions (Ref. No.110714), all environmental deficiencies were improved/ rectified by the Contractor. 	E1i.

	Name	Signature	Date
Recorded by	TY Yeung		21 July 2011
Checked by	Dr. Priscilla Choy		21 July 2011



Record Summary of Environmental Site Inspection

Inspection Information

Checklist Reference Number	110728
Date	28 th July 2011 (Thursday)
Time	10:00-11:00

Ref. No.	Non-Compliance	Related Item No.
-	None identified	-

Ref. No.	Remarks/Observations	Related Item No.
	<p>Part B - Water Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part C - Air Quality</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part D - Noise</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part E - Waste / Chemical Management</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part F - Permit / Licenses</p> <ul style="list-style-type: none"> No environmental deficiency was identified during the site inspection. 	
	<p>Part G - Reminder</p> <ul style="list-style-type: none"> The worn sand bag should be cleared near the gully at FC11B&12B. 	E6
110728-R01		E6
110728-R02	<ul style="list-style-type: none"> The deposited silt should be cleared along the haul road near FC11B&12B. 	E6
	<p>Others</p> <ul style="list-style-type: none"> Follow-up on the previous audit sessions (Ref. No.110721), all environmental deficiencies were improved/ rectified by the Contractor. 	

	Name	Signature	Date
Recorded by	TY Yeung		28 July 2011
Checked by	Dr. Priscilla Choy		28 July 2011

APPENDIX J
EVENT ACTION PLANS

APPENDIX J (1) – Event Action Plan for Air Quality Monitoring (Construction Phase)

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
ACTION LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. 	<ol style="list-style-type: none"> Check monitoring data submitted by ET; Check Contractor's working method. 	<ol style="list-style-type: none"> Notify Contractor. 	<ol style="list-style-type: none"> Rectify any unacceptable practice; Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Identify source; Inform IC(E) and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	<ol style="list-style-type: none"> Confirm receipt of notification of exceedance in writing; Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate.
LIMIT LEVEL				
1. Exceedance for one sample	<ol style="list-style-type: none"> Identify source, investigate the causes of exceedance and propose remedial measures; Inform Contractor, IEC, ER, and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	<ol style="list-style-type: none"> Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. 	<ol style="list-style-type: none"> Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented. 	<ol style="list-style-type: none"> Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.
2. Exceedance for two or more consecutive samples	<ol style="list-style-type: none"> Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IC(E), EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> Confirm receipt of notification of exceedance in writing; Notify Contractor; In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

APPENDIX J (2) – Event Action Plan for Construction Noise Monitoring (Construction Phase)

EVENT	ACTION			
	ET	IEC	ER	CONTRACTOR
<i>ACTION LEVEL</i>	<ol style="list-style-type: none"> 1. Notify IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the Contractor and formulate remedial measures; 5. Increase monitoring frequency to check mitigation effectiveness. 	<ol style="list-style-type: none"> 1. Review the analyzed results submitted by the ET; 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analyzed noise problem; 4. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals to IEC; 2. Implement noise mitigation proposals.
<i>LIMIT LEVEL</i>	<ol style="list-style-type: none"> 1. Identify source; 2. Inform IEC, ER, EPD and Contractor; 3. Repeat measurements to confirm findings; 4. Increase monitoring frequency; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Inform IEC, ER and EPD the causes and actions taken for the exceedances; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring. 	<ol style="list-style-type: none"> 1. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 2. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Require Contractor to propose remedial measures for the analysed noise problem; 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the ER until the exceedance is abated.

APPENDIX J (3) – Event Action Plan for Landfill Gas Monitoring (Construction Phase)

Parameter	Limit Level	Action Required
Oxygen	<19%	Ventilate to restore oxygen to >19%
	<18%	Stop works; Evacuate personnel / prohibit entry; Increase ventilation to restore oxygen to > 19%
Methane	>10% LEL (i.e. >0.5% by volume)	Post “no smoking signs; Prohibit hot works; Ventilate to restore methane to <10% LEL
	>20% LEL (i.e. >1% by volume)	Stop works; Evacuate personnel / prohibit entry; Increase ventilation to restore methane to <10% LEL
Carbon Dioxide	>0.5%	Ventilate to restore carbon dioxide to <0.5%
	>1.5%	Stop works; Evacuate personnel / prohibit entry; Increase ventilation to restore carbon dioxide to <0.5%

**APPENDIX K
UPDATED ENVIRONMENTAL
MITIGATION IMPLEMENTATION
SCHEDULE**

**APPENDIX K – Updated Environmental Mitigation Implementation Schedule
(During Construction Phase)**

Type of Impact	Recommended Mitigation Measures	Status
Air Quality	Dust mitigation measures stipulated in <i>the Air Pollution Control (Construction Dust) Regulation</i> shall be incorporated to control dust emission. Notice shall be given to authority prior to commencing of work	√
Noise	Use of quiet PME	N/A
	<p>Good Site Practice</p> <ul style="list-style-type: none"> • Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program; • Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program; • Mobile plant, if any, should be sited as far from NSRs as possible; • Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; • Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and • Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities. 	√
Water Quality	The practices outlined in ProPECC PN 1/94 Construction Site Drainage should be adopted to minimize the potential water quality impacts from construction site runoff and various construction activities. The recommendation to install perimeter drains to collect site runoff and to properly treat the runoff by settlement tank/treatment system shall apply to all sites including those for mainlaying works. Minimum distances of 100 m should be maintained between the discharge points of construction site runoff and the existing WSD saltwater intake at Tai Po.	√
	A discharge licence needs to be applied from EPD for discharging effluent from the construction site. The discharge quality is required to meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies with all the standards listed in the TM. Reuse and recycling of the treated effluent can minimize water consumption and reduce the effluent discharge volume. The beneficial uses of the treated effluent may include dust suppression, wheel washing and general cleaning. Monitoring of the discharge quality of treated effluent should be part of the Environmental Monitoring and Audit (EM&A) programme. Detailed effluent sampling programme for water quality control during construction phase should be submitted to EPD, AFCD and WSD for approval prior to commencement of the construction works.	√
	The construction programme should be properly planned to minimize soil excavation, if any, in rainy seasons. This prevents soil erosion from exposed soil surfaces. Any exposed soil surfaces should also be properly protected to minimize dust emission. In areas where a large amount of exposed soils exist, earth bunds or sand bags should be provided. Exposed stockpiles should be covered with tarpaulin or impervious sheets at all time. The stockpiles of materials should be placed in the locations away from any stream courses so as to avoid releasing materials into the water bodies. Final surfaces of earthworks should be compacted and protected by permanent work. It is suggested that haul roads should be paved with concrete and the temporary access roads are protected using crushed stone or gravel, wherever practicable. Wheel washing facilities should be provided at all site exits to ensure that earth, mud and debris would not be carried out of the works areas by vehicles.	√
	Good site practices should be adopted to clean the rubbish and litter on the construction sites so as to prevent the rubbish and litter from dropping into the nearby environment. It is recommended to clean the construction sites on a regular basis.	√

Type of Impact	Recommended Mitigation Measures	Status
	It is recommended to provide sufficient chemical toilets in the works areas. The toilet facilities should not be less than 30 m from any watercourse. A licensed waste collector should be deployed to clean the chemical toilets on a regular basis. The construction workers can also make use of the existing toilet facilities within the TPSTW as necessary.	√
	Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the project. Implementation of environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site.	√
	It is required to register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	√
	Any service shop and minor maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken with the areas appropriately equipped to control these discharges.	√
	<p>Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows:</p> <ul style="list-style-type: none"> • Suitable containers should be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport • Chemical waste containers should be suitably labelled to notify and warn the personnel who are handling the wastes to avoid accidents. • Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area. 	√
	Marine water quality monitoring should be carried out under emergency condition or during maintenance of the THEES tunnel to verify the findings of the water quality modelling. It is recommended that the maintenance of the THEES tunnel, if unavoidable, should be conducted during winter season or low flow periods and to avoid the “blooming” season of algae (normally from April to June) if practicable. Details of the monitoring requirements are specified in the EM&A Manual.	N/A

Type of Impact	Recommended Mitigation Measures	Status
Waste Management	<p>Good site practices during the construction activities include:</p> <ul style="list-style-type: none"> • Nomination of approved personnel, such as a site manager, to be responsible for good site practices, arrangements for collection and effective disposal to an appropriate facility, of all wastes generated at the site. • Training of site personnel in proper waste management and chemical waste handling procedures. • Provision of sufficient waste disposal points and regular collection for disposal. • Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. • Separation of chemical wastes for special handling and appropriate treatment at the Chemical Waste Treatment Facility. • Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors. • A Waste Management Plan shall be prepared and this WMP shall be submitted to the Engineer for approval. One may make reference to ETWB TCW No. 15/2003 for details. • In order to monitor the disposal of C&D materials at landfills and public filling areas, and to control fly tipping, a trip-ticket system shall be included as one of the contractual requirements and implemented by an Environmental Team undertaking the Environmental Monitoring and Audit work. One may make reference to WBTC No. 21/2002 for details. • A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) shall be proposed. 	√
	<p>Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:</p> <ul style="list-style-type: none"> • Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. • To encourage collection of aluminum cans by individual collectors, separate labelled bins shall be provided to segregate this waste from other general refuse generated by the work force. • Any unused chemicals or those with remaining functional capacity shall be recycled. • Maximize the use of reusable steel formwork to reduce the amount of C&D material. • Prior to disposal of C&D waste, it is recommended that wood, steel and other metals shall be separated for re-use and / or recycling to minimize the quantity of waste to be disposed of to landfill. • Proper storage and site practices to minimize the potential for damage or contamination of construction materials. • Plan and stock construction materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste. • Minimize over ordering of concrete, mortars and cement grout by doing careful check before ordering 	√
	<p><i>General Refuse</i></p> <p>General refuse shall be stored in enclosed bins or compaction units separate from C&D material. A reputable waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D material. An enclosed and covered area is preferred to reduce the occurrence of 'wind blown' light material.</p>	√
	<p><i>Construction & Demolition (C&D) Material</i></p> <p>C&D material generated from the site formation and demolition works shall be sorted on-site into inert C&D material (i.e. public fill) and C&D waste. In order to minimise the impact resulting from collection and transportation of C&D material for off-site disposal, the excavated material comprising fill material shall be reused on-site as backfilling material as far as practicable. C&D waste, such as wood, plastic, steel and other metals shall be reused or recycled and, as a last resort, disposed of to landfill. A suitable area shall be designated within the site for temporary stockpiling of C&D material and to facilitate the sorting process.</p>	√

Type of Impact	Recommended Mitigation Measures	Status
	<p><i>Bentonite Slurry</i></p> <p>Bentonite slurries used in construction works should be reconditioned and reused wherever practicable. Residual used bentonite slurry should be disposed of from the site as soon as possible. The Contractor should explore alternative disposal outlets for the residual used bentonite slurry and disposal at landfill should be the last resort.</p>	N/A
Landfill Gas Hazard	<p>All personnel who work on the site and all visitors to the site should be aware of the possibility of ignition of gas in the vicinity of excavations. Safety notices should be displayed at prominent position around the site. Adequate fire extinguisher equipment and fire resistant clothing should be made available on site.</p>	√
	<p>Service runs within the consultation zone should be designated as “special routes” and utilities companies should be informed of this and should implement precautionary measures.</p>	√
	<p>Precautionary measures to minimize landfill gas hazard during excavation:</p> <ul style="list-style-type: none"> • No smoking or burning shall be allowed • No worker shall work alone at any time in the confined space or any excavation trenches • Construction equipment shall be equipped with a vertical exhaust at least 0.6 m above ground level and /or with a park arrestors • Electrical motors and electrical extension cords shall be explosive-proof or intrinsically safe • Permit to Work procedures to be adopted for welding, flame cutting or other hot works in trenches or confined spaces • Forced ventilation if working in a trench deeper than 1 m • Close all valves immediately after piping assembly or conduiting construction. For the large diameter pipes, pipe end shall be capped on one side. Forced ventilation shall also be provided before commissioning of the pipeline and staff entering and working in it • Routine monitoring shall be conducted in all excavations to ensure the works area to be free of landfill gas before any man enters the area. • Landfill gas precautionary measures involved with excavation and piping works shall be included in the Safety Plan • Monitoring shall be conducted at the cracks on the ground floor during ground-works construction 	√
	<p>Where there are any temporary site offices, or any other buildings which have enclosed spaces with the capacity to accumulate landfill gas, then they should either:</p> <ul style="list-style-type: none"> • be located on an area which has been proven to be free of landfill gas (by survey with portable gas detectors) and monitored manually by the Safety Officer or an approved wand appropriately qualified person to ensure that hazardous concentration of landfill gas does not occur; or • be raised clear of the ground. If buildings are raised clear of the ground, a minimum, clear separation (as measured from the highest point on the ground surface to the underside of lowest floor joist) should be 500mm 	√

Note:

- √ – Compliance of mitigation measures
X – Non-compliance of mitigation measures
N/A – Not applicable

**APPENDIX L
WASTE GENERATION IN THE
REPORTING MONTH**

APPENDIX L – WASTE GENERATION IN THE REPORTING MONTH

Monthly Summary Waste Flow Table July 2011 (Year)

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Wastes Generated Monthly				
	Total Quantity Generated	Broken Concrete (see Note 3)	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastic (see Note 2)	Chemical Waste	Others, e.g. general refuse
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000m ³)
Jan	5.1	0	0	0	5.1	0	1.4	0	0	0	0.01
Feb	2.87	0	0	0.17	2.7	0	1.3	0	0	0	0.01
Mar	6.2	0	0	3.5	2.7	0	1.5	0	0	0	0.01
Apr	3.16	0	0	2.91	0.25	0	1.4	0	0	0	0.01
May	4.56	0	0	3.85	0.71	0	1.4	0	0	0.06	0.01
June	1.50	0	0	1.25	0.25	0	1.2	0	0	0	0.01
Sub-total	23.39	0	0	11.68	11.71	0	8.2	0	0	0.06	0.06
July	1.60	0	0	1.60	0	0	0	0	0	0	0.001
Aug											
Sept											
Oct											
Nov											
Dec											
Total											

- Notes:
- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
 - (2) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging material.
 - (3) Broken concrete for recycling into aggregates.

**APPENDIX M
COMPLAINT LOG**

APPENDIX M – COMPLAINT LOG**Reporting Month:** July 2011

Log Ref.	Location	Received Date	Details of Complaint	Investigation/Mitigation Action	Status
N/A	N/A	N/A	N/A	N/A	N/A

Remarks: No environmental complaint was received in the reporting month.

APPENDIX N
CONSTRUCTION PROGRAMME

Act ID	Description	Orig Dur	Early Start	Early Finish	Total Float	2010												2011												2012												2013											
						FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	
General																																																					
Project Key Dates																																																					
1000	Possession of Site	0		28JAN10	1155d	Possession of Site																																															
10000	Completion of Section I of Works (365d)	0		28JAN11	790d	◆ Completion of Section I of Works (365d)																																															
20000	Completion of Section II of Works (460d)	0		01JUN12	330d	◆ Completion of Section II of Works (460d)																																															
30000	Completion of Section III of Works (670d)	0		28DEC11	486d	◆ Completion of Section III of Works (670d)																																															
40000	Completion of Section IV of Works (365d)	0		28JAN11	820d	◆ Completion of Section IV of Works (365d)																																															
50000	Completion of Section V of Works (1185d)	0		27APR13	0	◆ Completion of Section V of Works																																															
Preliminary																																																					
1010	Site Clearance	30	29JAN10	27FEB10	0	Site Clearance																																															
1020	Contractor Site Office Set-up	60	28FEB10	28APR10	84d	Contractor Site Office Set-up																																															
1030	Engineer's Accommodation	60	28FEB10	28APR10	1035d	Engineer's Accommodation																																															
1040	Initial Survey	60	29JAN10	29MAR10	25d	Initial Survey																																															
1050	Condition Survey	60	29JAN10	29MAR10	2d	Condition Survey																																															
1060	Environmental Baseline Monitoring	14	30MAR10	12APR10	1111d	Environmental Baseline Monitoring																																															
Submission for Approval																																																					
2010	Engineer's Green Roof	60	29APR10	27JUN10	1035d	Engineer's Green Roof																																															
2020	Excavation and Lateral Support (ELS)	30	29APR10	28MAY10	84d	Excavation and Lateral Support (ELS)																																															
2030	Project Signboard	30	29APR10	28MAY10	1065d	Project Signboard																																															
2040	Pile Load Test Set-up	30	30MAR10	28APR10	2d	Pile Load Test Set-up																																															
2050	Falsewk & Fwk for Pile Cap	30	29MAY10	27JUN10	90d	Falsewk & Fwk for Pile Cap																																															
2060	Falsewk & Fwk for Wall Structure	30	28JUN10	27JUL10	90d	Falsewk & Fwk for Wall Structure																																															
2070	Falsewk & Fwk for Top Slab	30	28JUL10	26AUG10	840d	Falsewk & Fwk for Top Slab																																															
2080	Multi-part Cover	45	27AUG10	10OCT10	840d	Multi-part Cover																																															
2090	FRP Handrail, Stair & Floor	45	11OCT10	24NOV10	840d	FRP Handrail, Stair & Floor																																															
2100	FRP Cover	30	11OCT10	09NOV10	900d	FRP Cover																																															
2110	Aluminium Flooring	45	25NOV10	08JAN11	840d	Aluminium Flooring																																															
2120	Green Roof System at Sludge Dewatering House	60	29APR10	27JUN10	310d	Green Roof System at Sludge Dewatering House																																															
2130	Green Roof System at Transformer House	60	29APR10	27JUN10	1035d	Green Roof System at Transformer House																																															
Material Fabrication & Delivery																																																					
3010	Casing for Mini-pile	55	29APR10	22JUN10	173d	Casing for Mini-pile																																															
3020	Casing for Socketted H-pile	55	28FEB10	23APR10	0	Casing for Socketted H-pile																																															
3030	Steel Member for Socketted H-pile	55	28FEB10	23APR10	0	Steel Member for Socketted H-pile																																															
3040	DI Water Pipe Puddle & Tee	180	29JAN10	27JUL10	90d	DI Water Pipe Puddle & Tee																																															
3050	DI Water Pipeline	180	29JAN10	27JUL10	1005d	DI Water Pipeline																																															
3060	Steel Member for Shelter	60	29JAN10	29MAR10	1125d	Steel Member for Shelter																																															
Section I of Works																																																					
Drilling Works																																																					
10010	Section I of Work	365	29JAN10	28JAN11	0	Section I of Work																																															
10100	Pre-drilling Works (18 nos)	45	10MAR10	23APR10	0	Pre-drilling Works (18 nos)																																															
10110	Preliminary Socketted H-pile	7	24APR10	30APR10	0	Preliminary Socketted H-pile																																															
10120	Load Test for Preliminary Pile	14	01MAY10	14MAY10	0	Load Test for Preliminary Pile																																															
10130	Socketted H-piling (56 nos)	84	15MAY10	06AUG10	0	Socketted H-piling (56 nos)																																															
10140	Proof Drilling (4 nos)	14	07AUG10	20AUG10	0	Proof Drilling (4 nos)																																															
10150	Load Test for Main Pile (1 no)	14	07AUG10	20AUG10	0	Load Test for Main Pile (1 no)																																															
10160	Removal of DN525 & DN900 conc. pipe	45	04JUL10	17AUG10	164d	Removal of DN525 & DN900 conc. pipe																																															
Final Classifier No. FC11B & FC12B																																																					
11010	Excavation for FC12B	21	21AUG10	10SEP10	0	Excavation for FC12B																																															
11020	Pile Head Construction for FC12B	17	11SEP10	27SEP10	4d	Pile Head Construction for FC12B																																															
11025	Base Slab of FC12B	22	18OCT10	18OCT10	7d	Base Slab of FC12B																																															
11030	Structural Wall for FC12B	35	19OCT10	22NOV10	7d	Structural Wall for FC12B																																															
11040	Watertightness Test for FC12B	20	23NOV10	12DEC10	7d	Watertightness Test for FC12B																																															
11050	Concrete Coating for FC12B	10	18DEC10	27DEC10	32d	Concrete Coating for FC12B																																															
11060	Backfilling for FC12B	20	13DEC10	01JAN11	7d	Backfilling for FC12B																																															
12010	Excavation for 11B	21	11SEP10	01OCT10	0	Excavation for 11B																																															
12020	Pile Head Construction for FC11B	17	02OCT10	18OCT10	0	Pile Head Construction for FC11B																																															

Start date	29JAN10
Finish date	27APR13
Data date	29JAN10
Run date	06APR10
Page number	1A
© Primavera Systems, Inc.	

	Early bar
	Progress bar
	Critical bar
	Summary bar
	Start milestone point
	Finish milestone point

China Harbour Engineering Co. Ltd.
TPSTW Stage 5 Phase 2B

Date	Revision	Checked	Approved
05FEB10	0	WML	TKC
07APR10	1	AA	TKC

