


| ZONE | DEPTH WITH CONTAMINATED SOIL FOUND (m BELOW GROUND SURFACE) | CONTAMINANT IDENTIFIED | ESTIMATED EXTENT OF CONTAMINATION (m <sup>2</sup> ) | VOLUME (m <sup>3</sup> ) | PROPOSED REMEDIATION METHOD               |
|------|---|------------------------|---|--------------------------|---|
| T32C | 1.5-3.5   | LEAD                   | 78.5  | 157                      | SOLIDIFICATION / STABILIZATION            |
| T32D | 0.5-1.5   | PCB                    | 78.5  | 78.5                     | LANDFILL DISPOSAL                         |
| T32E | 0-1.5   | TPH                    | 654.2   | 750.5                    | BIOPILING, SOLIDIFICATION / STABILIZATION |
| T32E | 0-3   | PCB                    | 153.9   | 461.6                    | LANDFILL DISPOSAL                         |
| T36A | 0-1.5   | LEAD                   | 153.9   | 117.75                   | SOLIDIFICATION / STABILIZATION            |



NOTE:  
LOCATION AND SIZE OF THE EXCAVATION ZONES AND THEIR CORRESPONDING CONFIRMATORY SAMPLING LOCATIONS ARE INDICATIVE ONLY

| LEGEND                  |   |
|-------------------------|---|
| [Outline]               | SITE EXTENT   |
| [Hatched Area]          | PROPOSED CONTAMINATED ZONE TO BE EXCAVATED            |
| [Crosshair]             | PIT BOTTOM CONFIRMATORY SAMPLING LOCATION             |
| [Circle with Crosshair] | PIT TOP AND PIT BOTTOM CONFIRMATORY SAMPLING LOCATION |
| [Square with Crosshair] | SIDEWALL CONFIRMATORY SAMPLING LOCATION               |

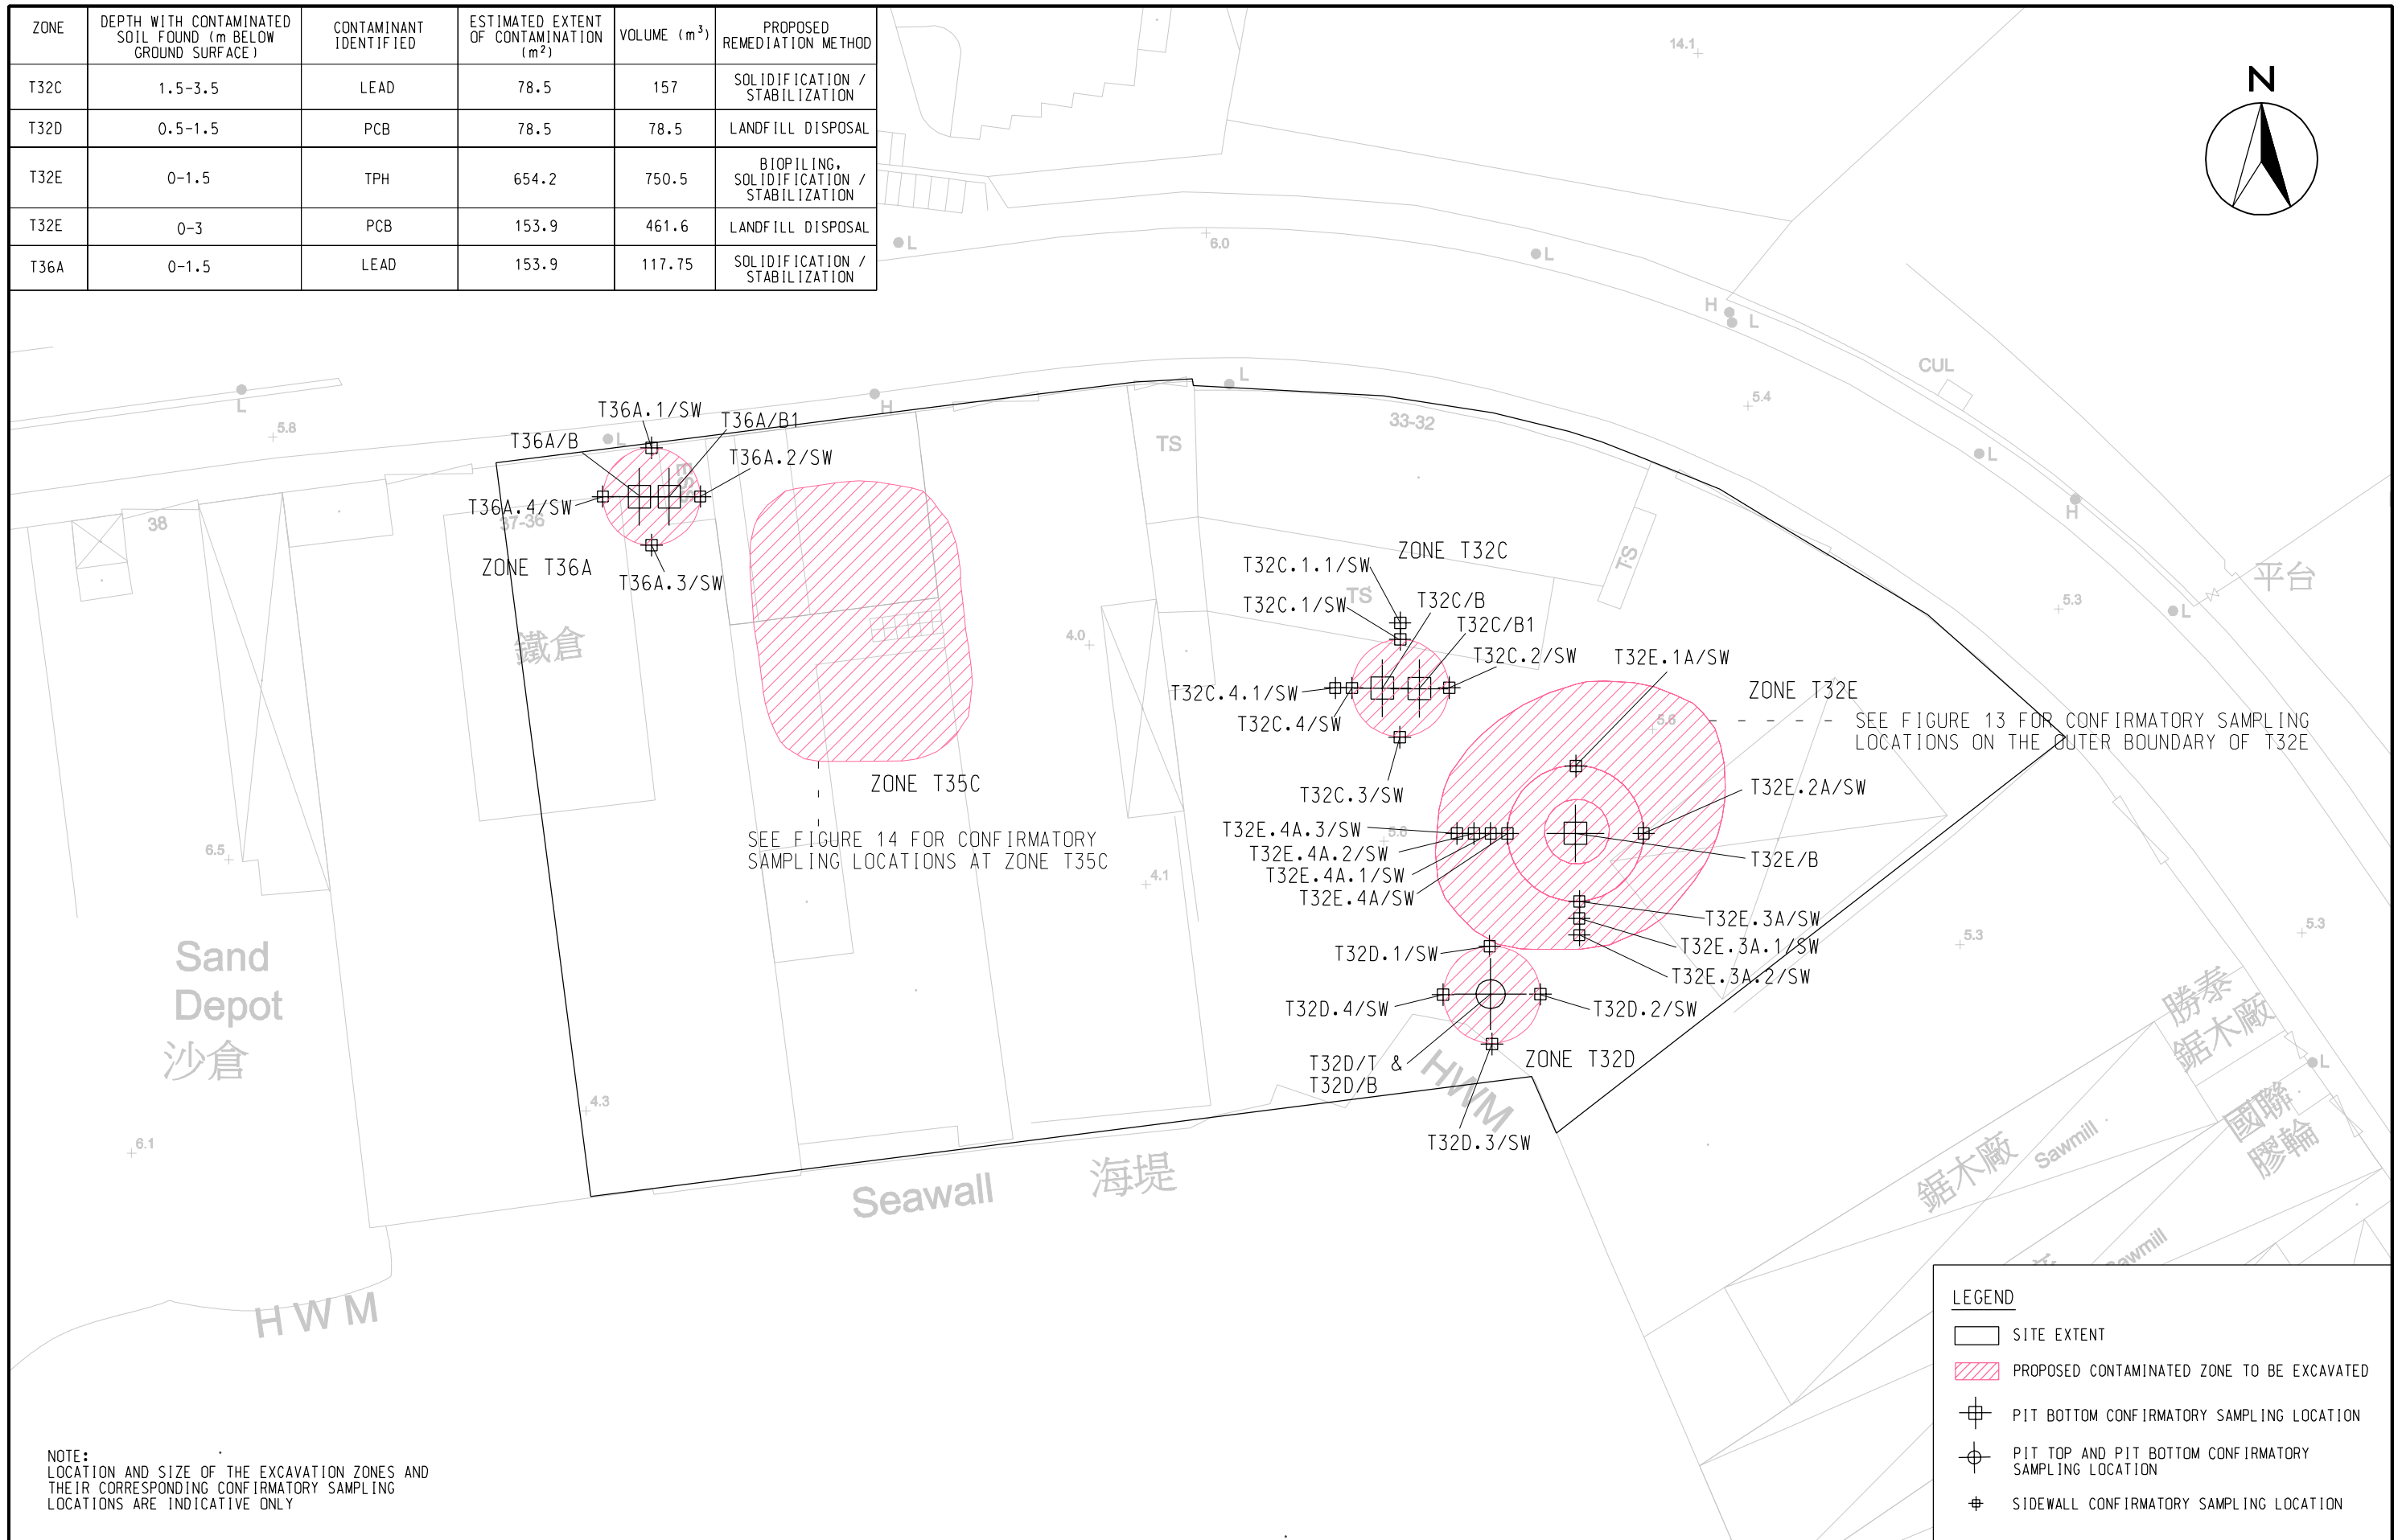

YAU TONG BAY REDEVELOPMENT  
LAND DECONTAMINATION WORKS

LOCATION OF CONFIRMATORY SAMPLING (ZONES T32C, T32D, T32E, T35C AND T36A)

|             |            |            |          |
|-------------|------------|------------|----------|
| SCALE       | A3 1 : 600 | DATE       | MAR 2014 |
| CHECK       | LLHY       | DRAWN      | KW       |
| PROJECT NO. | 60048208   | FIGURE NO. | 11       |
|             |            | REV        | -        |