

**JOB NO.: TCS00694/13** 

AGREEMENT NO. CE 45/2008 (CE) LIANTANG/ HEUNG YUEN WAI BOUNDARY CONTROL POINT AND ASSOCIATED WORKS

MONTHLY ENVIRONMENTAL MONITORING AND AUDIT REPORT (NO.108) – JULY 2022

PREPARED FOR
CIVIL ENGINEERING AND DEVELOPMENT DEPARTMENT
(CEDD)

Date Reference No. Prepared By Certified By

11 August 2022 TCS00694/13/600/R2762v2

Nicola Hon (Environmental Consultant) Tam Tak Wing (Environmental Team Leader)

Version	Date	Remarks
1	5 August 2022	First Submission
2	11 August 2022	Amended As Per IEC's comment on 11 August 2022



# local people global experience

Our ref:

7076192/L28932/AW/CL/TK/rw

11 August 2022

AECOM 12/F, Grand Central Plaza, Tower 2 138 Shatin Rural Committee Road Shatin, N.T.

By Email & Post

Attention: Mr Eddie LUK

Dear Sir

Agreement No. CE 45/2008 (CE)
Liantang/Heung Yuen Wai Boundary Control Point and Associated Works
Independent Environmental Checker – Investigation
Monthly EM&A Report (No. 108) – July 2022

With reference to the Monthly EM&A Report No. 108 for July 2022 (Version 2) certified by the ET Leader, please note that we have no adverse comment on the captioned submission. We herewith verify the captioned submission in accordance with Condition 5.4 of the Environmental Permit No. EP-404/2011/D.

Thank you for your attention. Should there be any queries, please do not hesitate to contact the undersigned on tel. 3995-8120 or by email to antony.wong@smec.com; or our Mr Charls LIANG on tel. 3995-8128 or by email to charls.liang@smec.com.

Yours faithfully

Antony WONG

Independent Environmental Checker

cc CEDD/BCP

Mr LU Pei Yu / Mr YW LAM

by fax: 3547 1659

AECOM

Mr Anthony WONG

by email

CCKJV

Mr Vincent CHAN

by email

AUES

Mr TW TAM

by email

**SMEC ASIA LIMITED** 

27/F Ford Glory Plaza, 37-39 Wing Hong Street Cheung Sha Wan, Kowloon, Hong Kong

T +852 3995 8100

F +852 3995 8101

E hongkong@smec.com

W www.smec.com







# **EXECUTIVE SUMMARY**

ES01 This is the 108<sup>th</sup> monthly Environmental Monitoring & Audit (EM&A) report presenting the monitoring results and inspection findings for the reporting period from 1 to 31 July 2022 (hereinafter 'the Reporting Period').

#### **ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES**

- ES02 To facilitate the project management and implementation, Liantang/Heung Yuen Wai Boundary Control Point and Associated Works of the Project is divided to six CEDD contracts including Contract 2 (CV/2012/08), Contract 3 (CV/2012/09), Contract 4 (NE/2014/02), Contract 5 (CV/2013/03), Contract 6 (CV/2013/08) and Contract 7 (NE/2014/03) and an ArshSD contract (Contract SS C505).
- ES03 Substantial completion for the Works has been achieved for all Contracts in 2019. Proposal for partial termination of the construction phase EM&A programme for Contracts 2, 4, 7 and SS C505 was approved by EPD on 9 July 2020 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.17). Moreover, termination proposal for Contract 3 was approved by EPD on 4 May 2021 (EPD's ref.: () in Ax (3) to EP 2/N7/A52 Pt.18). Therefore, air quality monitoring stations AM1c, AM8 & AM9b, noise monitoring stations NM1, NM7, NM8, NM9 & NM10 and water quality monitoring stations WM4, WM4-CA & WM4-CB and ET's site inspection and audit for relevant works area for Contracts 2, 3, 4, 7 and SS C505 was ceased accordingly.
- ES04 In the Reporting Period, environmental monitoring activities under the EM&A programme in the Reporting Period are summarized in the following table.

Environmental	<b>Environmental Monitoring</b>	Reporting Period		
Aspect	Parameters / Inspection	Number of Monitoring Locations to undertake	Total Occasions	
A in Ovolity	1-hour TSP(\$)	6 (#)	90	
Air Quality	24-hour TSP	6 (#)	30	
Construction Noise	L <sub>eq(30min)</sub> Daytime	5 (~)	20	
		WM1 & WM1-C	12 Scheduled & 0 extra (*)	
Water Quality	Water in-situ measurement and/or sampling(\$)	WM2A(a) & WM2A-Cx	12 Scheduled & 0 extra (*)	
water Quanty		WM2B & WM2B-C	12 Scheduled & 0 extra (*)	
		WM3x &WM3-C	12 Scheduled & 0 extra (*)	
Joint Site	ET and the Contractor joint site Environmental Inspection and Auditing	0.4	4	
Inspection / Audit	ET, the Contractor, IEC and RE joint site Environmental Inspection and Auditing	Contract 6	1	

#### Remark

- (\*) Water sampling was unable to carry out at WM2B and WM2B-C in the Reporting Period due to shallow water. Besides, WM3-C was also unable to carry out and WM1-C was also unable to carry out some of the monitoring days in the Reporting Period due to shallow water. (Water depth under 150mm). WM4, WM4-CA and WM4-CB were ceased after last monitoring carried out on 3 May 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021.
- (#) Number of air monitoring location changed to 6 since the partial termination proposal approved by EPD on 9 Jul 2020 and 4 May 2021.
- (~) Number of noise monitoring location changed to 5 since the partial termination proposal approved by EPD on 9 Jul 2020 and 4 May 2021.
- (\$)1-Hour TSP monitoring at AM2&3 and Water Quality Monitoring on 2 July 2022 were cancelled due to adverse weather condition (Typhoon Signal No. 8 in force). The 1-hour TSP monitoring at AM2&3 was rescheduled to 4 July 2022.



## ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE

ES05 In the Reporting Period, no exceedance was recorded for construction noise, air quality and water quality monitoring. The summary of exceedance in the Reporting Period is shown below.

				Event & Action			
Environmental Aspect	Monitoring Parameters	Action Level	Limit Level	NOE Issued	Investigation Result	Project related exceedance	Corrective Actions
Air Quality	1-hour TSP	0	0	0			
7 in Quanty	24-hour TSP	0	0	0			
Construction Noise	L <sub>eq(30min)</sub> Daytime	0	0	0			
	DO	0	0	0			
Water Quality	Turbidity	0	0	0			
	SS	0	0	0	==		

## **ENVIRONMENTAL COMPLAINT**

ES06 No environmental complaint was recorded in the Reporting Period.

#### NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

ES07 No environmental summons and prosecutions were recorded in the Reporting Period.

#### REPORTING CHANGE

ES08 No reporting change was recorded in the Reporting period.

## **SITE INSPECTION**

ES09 In the Reporting Period, joint site inspection has been carried out by the ET and the Contractor on 7, 14, 21 and 28 July 2022. Joint site inspection with ET, the Contractor, IEC and RE was carried out on 28 July 2022. No non-compliance was noted during the site inspection.

## **FUTURE KEY ISSUES**

ES10 Since the construction works under the Project were substantial completed, the potential environmental impacts associated with Project are considered negligible. However, the Contractor was reminded that the environmental mitigation measures shall be properly implemented and maintained where applicable, as per the Mitigation Implementation Schedule, in the remaining construction period and operational phase.



# **Table of Contents**

1	INTRODUCTION	1
	1.1 PROJECT BACKGROUND	1
	1.2 REPORT STRUCTURE	1
2	PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS	3
	2.1 CONSTRUCTION CONTRACT PACKAGING	3
	2.2 PROJECT ORGANIZATION	3 5 7
	2.3 CONCURRENT PROJECTS	
	2.4 CONSTRUCTION PROGRESS	8
	2.5 SUMMARY OF ENVIRONMENTAL SUBMISSIONS	8
3	SUMMARY OF IMPACT MONITORING REQUIREMENTS	9
	3.1 GENERAL	9
	3.2 MONITORING PARAMETERS	9
	3.3 MONITORING LOCATIONS	9
	3.4 MONITORING FREQUENCY AND PERIOD  3.5 MONITORING FOLUMENTS	12 12
	3.5 MONITORING EQUIPMENT 3.6 MONITORING METHODOLOGY	12
	3.7 EQUIPMENT CALIBRATION	16
	3.8 DERIVATION OF ACTION/LIMIT (A/L) LEVELS	17
	3.9 DATA MANAGEMENT AND DATA QA/QC CONTROL	18
4	AIR QUALITY MONITORING	19
-	4.1 GENERAL	19
	4.2 AIR QUALITY MONITORING RESULTS	19
_		
5	CONSTRUCTION NOISE MONITORING 5.1 GENERAL	<b>21</b> 21
	5.2 Noise Monitoring Results	21
_		
6	WATER QUALITY MONITORING	22
	<ul><li>6.1 GENERAL</li><li>6.2 RESULTS OF WATER QUALITY MONITORING</li></ul>	22 22
	•	
7	ECOLOGY MONITORING	24
	7.1 MONITORING ON WOODLAND COMPENSATION	24
	7.2 MONITORING ON WETLAND COMPENSATION	24
8	WASTE MANAGEMENT	25
	8.1 GENERAL WASTE MANAGEMENT	25
	8.2 RECORDS OF WASTE QUANTITIES	25
9	SITE INSPECTION	26
	9.1 REQUIREMENTS	26
	9.2 FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH	26
10	ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE	27
	10.1 Environmental Complaint, Summons and Prosecutions	27
11	IMPLEMENTATION STATUS OF MITIGATION MEASURES	28
-	11.1 GENERAL REQUIREMENTS	28
	11.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH	28
	11.3 KEY ISSUES FOR THE COMING MONTH	28
12	CONCLUSIONS AND RECOMMENDATIONS	30
	12.1 CONCLUSIONS	30
	12.2 RECOMMENDATIONS	30



# **LIST OF TABLES**

TABLE 2-1	STATUS OF ENVIRONMENTAL LICENSES AND PERMITS OF THE CONTRACTS
TABLE 3-1	SUMMARY OF EM&A REQUIREMENTS
TABLE 3-2	IMPACT MONITORING STATIONS - AIR QUALITY
TABLE 3-3	IMPACT MONITORING STATIONS - CONSTRUCTION NOISE
TABLE 3-4	IMPACT MONITORING STATIONS - WATER QUALITY
TABLE 3-5	AIR QUALITY MONITORING EQUIPMENT
Table 3-6	CONSTRUCTION NOISE MONITORING EQUIPMENT
TABLE 3-7	WATER QUALITY MONITORING EQUIPMENT
TABLE 3-8	ACTION AND LIMIT LEVELS FOR AIR QUALITY MONITORING
Table 3-9	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE
TABLE 3-10	ACTION AND LIMIT LEVELS FOR WATER QUALITY
TABLE 4-1	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM2
TABLE 4-2	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM3
TABLE 4-3	Summary of 24-hour and 1-hour TSP Monitoring Results – $AM4\mbox{\sc b}$
TABLE 4-4	Summary of 24-hour and 1-hour TSP Monitoring Results – $AM5\mathrm{A}$
TABLE 4-5	SUMMARY OF 24-HOUR AND 1-HOUR TSP MONITORING RESULTS – AM6
Table 4-6	Summary of 24-hour and 1-hour TSP Monitoring Results – $AM7\mbox{\ensuremath{B}}$
TABLE 5-1	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS
TABLE 5-2	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS
Table 6-1	WATER QUALITY MONITORING RESULTS ASSOCIATED CONTRACTS 6
TABLE 6-2	WATER QUALITY MONITORING RESULTS ASSOCIATED CONTRACT 6
TABLE 6-3	WATER QUALITY MONITORING RESULTS ASSOCIATED CONTRACTS 6
Table 6-4	ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE RECORDED
Table 8-1	SUMMARY OF QUANTITIES OF INERT C&D MATERIALS FOR THE PROJECT
TABLE 8-2	SUMMARY OF QUANTITIES OF C&D WASTES FOR THE PROJECT
Table 9-1	SITE OBSERVATIONS FOR CONTRACT 6
Table 10-1	STATISTICAL SUMMARY OF ENVIRONMENTAL COMPLAINTS
TABLE 10-2	STATISTICAL SUMMARY OF ENVIRONMENTAL SUMMONS
TABLE 10-3	STATISTICAL SUMMARY OF ENVIRONMENTAL PROSECUTIONS

# **LIST OF APPENDICES**

APPENDIX A	LAYOUT PLAN OF THE PROJECT
APPENDIX B	ORGANIZATION CHART
APPENDIX C	3-MONTH ROLLING CONSTRUCTION PROGRAM
APPENDIX D	DESIGNATED MONITORING LOCATIONS AS RECOMMENDED IN THE APPROVED EM&A MANUAL
APPENDIX E	MONITORING LOCATIONS FOR IMPACT MONITORING
APPENDIX F	CALIBRATION CERTIFICATE OF MONITORING EQUIPMENT AND HOKLAS-ACCREDITATION CERTIFICATE OF THE TESTING LABORATORY
APPENDIX G	EVENT AND ACTION PLAN
APPENDIX H	IMPACT MONITORING SCHEDULE
APPENDIX I	DATABASE OF MONITORING RESULT
APPENDIX J	GRAPHICAL PLOTS FOR MONITORING RESULT
APPENDIX K	METEOROLOGICAL DATA
APPENDIX L	WASTE FLOW TABLE

# Agreement No. CE 45/2008 (CE) Liantang/Heung Yuen Wai Boundary Control Point and Associated Works Monthly Environmental Monitoring & Audit Report (No.108) – July 2022



APPENDIX M IMPLEMENTATION SCHEDULE FOR ENVIRONMENTAL MITIGATION MEASURES
APPENDIX N IMPLEMENTATION STATUS OF MITIGATION MEASURES FOR OPERATION PHASE

APPENDIX O COMPLAINT LOG



#### 1 INTRODUCTION

#### 1.1 PROJECT BACKGROUND

- 1.1.1 Civil Engineering and Development Department is the Project Proponent and the Permit Holder of *Agreement No. CE 45/2008 (CE) Liantang / Heung Yuen Wai Boundary Control Point and Associated Works*, which is a Designated Project to be implemented under Environmental Permit number EP-404/2011/D granted on 20 January 2017.
- 1.1.2 The Project consists of two main components: Construction of a Boundary Control Point (hereinafter referred as "BCP"); and Construction of a connecting road alignment. Layout plan of the Project is shown in *Appendix A*.
- 1.1.3 The proposed BCP is located at the boundary with Shenzhen near the existing Chuk Yuen Village, comprising a main passenger building with passenger and cargo processing facilities and the associated customs, transport and ancillary facilities. The connecting road alignment consists of six main sections:
  - 1) Lin Ma Hang to Frontier Closed Area (FCA) Boundary this section comprises at-grade and viaducts and includes the improvement works at Lin Ma Hang Road;
  - 2) Ping Yeung to Wo Keng Shan this section stretches from the Frontier Closed Area Boundary to the tunnel portal at Cheung Shan and comprises at-grade and viaducts including an interchange at Ping Yeung;
  - 3) North Tunnel this section comprises the tunnel segment at Cheung Shan and includes a ventilation building at the portals on either end of the tunnel;
  - 4) Sha Tau Kok Road this section stretches from the tunnel portal at Wo Keng Shan to the tunnel portal south of Loi Tung and comprises at-grade and viaducts including an interchange at Sha Tau Kok and an administration building;
  - 5) South Tunnel this section comprises a tunnel segment that stretches from Loi Tung to Fanling and includes a ventilation building at the portals on either end of the tunnel as well as a ventilation building in the middle of the tunnel near Lau Shui Heung;
  - 6) Fanling this section comprises the at-grade, viaducts and interchange connection to the existing Fanling Highway.
- 1.1.4 Action-United Environmental Services & Consulting has been commissioned as an Independent ET to implement the relevant EM&A program in accordance with the approved EM&A Manual, as well as the associated duties. As part of the EM&A program, the baseline monitoring has carried out between 13 June 2013 and 12 July 2013 for all parameters including air quality, noise and water quality before construction work commencement. The Baseline Monitoring Report summarized the key findings and the rationale behind determining a set of Action and Limit Levels (A/L Levels) from the baseline data. Also, the Project baseline monitoring report which verified by the IEC has been submitted to EPD on 16 July 2013 for endorsement. The major construction works of the Project was commenced on 16 August 2013 in accordance with the EP Section 5.3 stipulation.
- 1.1.5 This is **108**<sup>th</sup> monthly EM&A report presenting the monitoring results and inspection findings for reporting period from **1** to **31 July 2022**.

# 1.2 REPORT STRUCTURE

1.2.1 The Monthly Environmental Monitoring and Audit (EM&A) Report is structured into the following sections:-

**Section 1** Introduction

Section 2 Project Organization and Construction Progress

Section 3 Summary of Impact Monitoring Requirements

Section 4 Air Quality Monitoring

Section 5 Construction Noise Monitoring

# Agreement No. CE 45/2008 (CE) Liantang/Heung Yuen Wai Boundary Control Point and Associated Works Monthly Environmental Monitoring & Audit Report (No.108) – July 2022



Section 6	Water Quality Monitoring
Section 7	Ecology Monitoring
Section 8	Waste Management
Section 9	Site Inspections
Section 10	Environmental Complaints and Non-Compliance
Section 11	Implementation Status of Mitigation Measures
Section 12	Conclusions and Recommendations



#### 2 PROJECT ORGANIZATION AND CONSTRUCTION PROGRESS

### 2.1 CONSTRUCTION CONTRACT PACKAGING

- 2.1.1 To facilitate the project management and implementation, the Project would be divided by the following contracts:
  - Contract 2 (CV/2012/08)
  - Contract 3 (CV/2012/09)
  - Contract 4 (NE/2014/02)
  - Contract 5 (CV/2013/03)
  - Contract 6 (CV/2013/08)
  - Contract 7 (NE/2014/03)
  - ArchSD Contract No. SS C505
- 2.1.2 The details of each contracts is summarized below and the delineation of each contracts is shown in *Appendix A*.

## Contract 2 (CV/2012/08)

- 2.1.3 Contract 2 has awarded in December 2013 and construction work was commenced on 19 May 2014. Major Scope of Work of the Contract 2 is listed below:
  - construction of an approximately 5.2km long dual two-lane connecting road (with about 0.4km of at-grade road and 4.8km of tunnel) connecting the Fanling Interchange with the proposed Sha Tau Kok Interchange;
  - construction of a ventilation adit tunnel and the mid-ventilation building;
  - construction of the north and south portal buildings of the Lung Shan Tunnel and their associated slope works;
  - provision and installation of ventilation system, E&M works and building services works for Lung Shan tunnel and Cheung Shan tunnel and their portal buildings;
  - construction of Tunnel Administration Building adjacent to Wo Keng Shan Road and the associated E&M and building services works; and
  - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

# Contract 3 (CV/2012/09)

- 2.1.4 Contract 3 was awarded in July 2013 and construction work was commenced on 5 November 2013. Major Scope of Work of the Contract 3 is listed below:
  - construction of four link roads connecting the existing Fanling Highway and the south portal of the Lung Shan Tunnel;
  - realignment of the existing Tai Wo Service Road West and Tai Wo Service Road East;
  - widening of the existing Fanling Highway (HyD's entrustment works);
  - demolishing existing Kiu Tau vehicular bridge and Kiu Tau footbridge and reconstruction of the existing Kiu Tau Footbridge (HyD's entrustment works); and
  - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

#### Contract 4 (NE/2014/02)

- 2.1.5 Contract 4 has awarded in mid-April 2016 and construction work was commenced on 2 May 2017. The scope of work of the Contract 4 includes:
  - design, supply, delivery, installation, testing and commissioning of a traffic control and surveillance system for the connecting road linking up the Liantang / Heung Yuen Wai Boundary Control Point and the existing Fanling Highway.



# Contract 5 (CV/2013/03)

- 2.1.6 Contract 5 has awarded in April 2013 and construction work was commenced in August 2013. Major Scope of Work of the Contract 5 is listed below:
  - site formation of about 23 hectares of land for the development of the BCP;
  - construction of an approximately 1.6 km long perimeter road at the BCP including a 175m long depressed road;
  - associated diversion/modification works at existing local roads and junctions including Lin Ma Hang Road;
  - construction of pedestrian subway linking the BCP to Lin Ma Hang Road;
  - provision of resite area with supporting infrastructure for reprovisioning of the affected village houses; and
  - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

# Contract 6 (CV/2013/08)

- 2.1.7 Contract 6 has awarded in June 2015 and construction work was commenced on 23 October 2015. Major Scope of Work of the Contract 6 would be included below:
  - construction of an approximately 4.6km long dual two-lane connecting road (with about 0.6km of at-grade road, 3.3km of viaduct and 0.7km of tunnel) connecting the BCP with the proposed Sha Tau Kok Road Interchange and the associated ventilation buildings;
  - associated diversion/modification works at access roads to the resite of Chuk Yuen Village;
  - provision of sewage collection, treatment and disposal facilities for the BCP and the resite of Chuk Yuen Village;
  - construction of a pedestrian subway linking the BCP to Lin Ma Hang Road;
  - provisioning of the affected facilities including Wo Keng Shan Road garden; and
  - construction of associated footpath, slopes, retaining structures, drainage, sewerage, waterworks, landscaping works and other ancillary works.

#### Contract 7 (NE/2014/03)

- 2.1.8 Contract 7 has awarded in December 2015 and the construction works of Contract 7 was commenced on 15 February 2016. Major Scope of Work of the Contract 7 would be included below:
  - construction of the Hong Kong Special Administrative Region (HKSAR) portion of four vehicular bridge
  - construction of one pedestrian bridge crossing Shenzhen (SZ) River (cross boundary bridges)

### ArchSD Contract No. SS C505

- 2.1.9 SS C505 has awarded in July 2015 and construction work was commenced on 1 September 2015. Major Scope of Work of the SS C505 would be included below:
  - passenger-related facilities including processing kiosks and examination facilities for private cars and coaches, passenger clearance building and halls, the interior fitting works for the pedestrian bridge crossing Shenzhen River, etc.;
  - cargo processing facilities including kiosks for clearance of goods vehicles, customs inspection platforms, X-ray building, etc.;
  - accommodation for the facilities inside of the Government departments providing services in connection with the BCP:
  - transport-related facilities inside the BCP including road networks, public transport interchange, transport drop-off and pick-up areas, vehicle holding areas and associated road furniture etc;



- a public carpark; and
- other ancillary facilities such as sewerage and drainage, building services provisions and electronic systems, associated environmental mitigation measure and landscape works.

#### 2.2 PROJECT ORGANIZATION

2.2.1 The project organization is shown in *Appendix B*. The responsibilities of respective parties are:

## Civil Engineering and Development Department (CEDD)

2.2.2 CEDD is the Project Proponent and the Permit Holder of the EP of the development of the Project and will assume overall responsibility for the project. An Independent Environmental Checker (IEC) shall be employed by CEDD to audit the results of the EM&A works carried out by the ET.

# Architectural Services Department (ArchSD)

2.2.3 ArchSD acts as the works agent for Development Bureau (DEVB), for Contract SS C505 Liantang/ Heung Yuen Wai Boundary Control Point (BCP) – BCP Buildings and Associated Facilities.

# Environmental Protection Department (EPD)

2.2.4 EPD is the statutory enforcement body for environmental protection matters in Hong Kong.

## Ronald Lu & Partners (Hong Kong) Ltd (The Architect)

- 2.2.5 Ronald Lu & Partners (Hong Kong) Ltd is appointed by ArchSD as an Architect for Contract SS C505 Liantang/ Heung Yuen Wai Boundary Control Point (BCP) BCP Buildings and Associated Facilities. It responsible for overseeing the construction works of Contract SS C505 and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the Architect with respect to EM&A are:
  - Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
  - Monitor Contractors' and ET's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
  - Facilitate ET's implementation of the EM&A programme
  - Participate in joint site inspection by the ET and IEC
  - Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance
  - Adhere to the procedures for carrying out complaint investigation
  - Liaison with DSD, Engineer/Engineer's Representative, ET, IEC and the Contractor of the "Construction of the DSD's Regulation of Shenzhen River Stage 4 (RSR 4)" Project discussing regarding the cumulative impact issues.

## Engineer or Engineers Representative (ER)

- 2.2.6 The ER is responsible for overseeing the construction works and for ensuring that the works are undertaken by the Contractor in accordance with the specification and contract requirements. The duties and responsibilities of the ER with respect to EM&A are:
  - Monitor the Contractors' compliance with contract specifications, including the implementation and operation of the environmental mitigation measures and their effectiveness
  - Monitor Contractors's, ET's and IEC's compliance with the requirements in the Environmental Permit (EP) and EM&A Manual
  - Facilitate ET's implementation of the EM&A programme



- Participate in joint site inspection by the ET and IEC
- Oversee the implementation of the agreed Event / Action Plan in the event of any exceedance
- Adhere to the procedures for carrying out complaint investigation
- Liaison with DSD, Engineer/Engineer's Representative, ET, IEC and the Contractor of the "Construction of the DSD's Regulation of Shenzhen River Stage 4 (RSR 4)" Project discussing regarding the cumulative impact issues.

# *The Contractor(s)*

- 2.2.7 There will be one contractor for each individual works contract. Once the contractors are appointed, EPD, ET and IEC will be notified the details of the contractor.
- 2.2.8 The Contractor for Contracts under CEDD should report to the ER. For ArchSD Contract, the Contractor should report to the Architect or Architect's Representative (AR). The duties and responsibilities of the Contractor are:
  - Comply with the relevant contract conditions and specifications on environmental protection
  - Employ an Environmental Team (ET) to undertake monitoring, laboratory analysis and reporting of EM &A Facilitate ET's monitoring and site inspection activities
  - Participate in the site inspections by the ET and IEC, and undertake any corrective actions
  - Provide information / advice to the ET regarding works programme and activities which may contribute to the generation of adverse environmental impacts
  - Submit proposals on mitigation measures in case of exceedances of Action and Limit levels in accordance with the Event / Action Plans
  - Implement measures to reduce impact where Action and Limit levels are exceeded
  - Adhere to the procedures for carrying out complaint investigation

#### Environmental Team (ET)

- 2.2.9 Once the ET is appointed, the EPD, CEDD, ER, Architect and IEC will be notified the details of the ET.
- 2.2.10 The ET shall not be in any way an associated body of the Contractor(s), and shall be employed by the Project Proponent/Contractor to conduct the EM&A programme. The ET should be managed by the ET Leader. The ET Leader shall be a person who has at least 7 years' experience in EM&A and has relevant professional qualifications. Suitably qualified staff should be included in the ET, and resources for the implementation of the EM&A programme should be allocated in time under the Contract(s), to enable fulfillment of the Project's EM&A requirements as specified in the EM&A Manual during construction of the Project. The ET shall report to the Project Proponent and the duties shall include:
  - Monitor and audit various environmental parameters as required in this EM&A Manual
  - Analyse the environmental monitoring and audit data, review the success of EM&A
    programme and the adequacy of mitigation measures implemented, confirm the validity of
    the EIA predictions and identify any adverse environmental impacts arising
  - Carry out regular site inspection to investigate and audit the Contractors' site practice, equipment/plant and work methodologies with respect to pollution control and environmental mitigation, and effect proactive action to pre-empt problems
  - Monitor compliance with conditions in the EP, environmental protection, pollution prevention and control regulations and contract specifications
  - Audit environmental conditions on site
  - Report on the environmental monitoring and audit results to EPD, the ER, the Architect, the IEC and Contractor or their delegated representatives
  - Recommend suitable mitigation measures to the Contractor in the case of exceedance of Action and Limit levels in accordance with the Event and Action Plans
  - Liaise with the IEC on all environmental performance matters and timely submit all relevant



EM&A proforma for approval by IEC

- Advise the Contractor(s) on environmental improvement, awareness, enhancement measures etc., on site
- Adhere to the procedures for carrying out complaint investigation
- Liaison with the client departments, Engineer/Engineer's Representative, ET, IEC and the Contractor(s) of the concurrent projects as listed under Section 2.3 below regarding the cumulative impact issues.

## Independent Environmental Checker (IEC)

- 2.2.11 One IEC will be employed for this Project. Once the IEC is appointed, EPD, ER, the Architect and ET will be notified the details of the IEC.
- 2.2.12 The Independent Environmental Checker (IEC) should not be in any way an associated body of the Contractor or the ET for the Project. The IEC should be employed by the Permit Holder (i.e., CEDD) prior to the commencement of the construction of the Project. The IEC should have at least 10 years' experience in EM&A and have relevant professional qualifications. The appointment of IEC should be subject to the approval of EPD. The IEC should:
  - Provide proactive advice to the ER and the Project Proponent on EM&A matters related to the project, independent from the management of construction works, but empowered to audit the environmental performance of construction
  - Review and audit all aspects of the EM&A programme implemented by the ET
  - Review and verify the monitoring data and all submissions in connection with the EP and EM&A Manual submitted by the ET
  - Arrange and conduct regular, at least monthly site inspections of the works during construction phase, and ad hoc inspections if significant environmental problems are identified
  - Check compliance with the agreed Event / Action Plan in the event of any exceedance
  - Check compliance with the procedures for carrying out complaint investigation
  - Check the effectiveness of corrective measures
  - Feedback audit results to ET by signing off relevant EM&A proforma
  - Check that the mitigation measures are effectively implemented
  - Verify the log-book(s) mentioned in Condition 2.2 of the EP, notify the Director by fax, within one working day of receipt of notification from the ET Leader of each and every occurrence, change of circumstances or non-compliance with the EIA Report and/or the EP, which might affect the monitoring or control of adverse environmental impacts from the Project
  - Report the works conducted, the findings, recommendation and improvement of the site inspections, after reviewing ET's and Contractor's works, and advices to the ER and Project Proponent on a monthly basis
  - Liaison with the client departments, Engineer/Engineer's Representative, the Architect, ET, IEC and the Contractor of the concurrent projects as listed under Section 2.3 below regarding the cumulative impact issues.

#### 2.3 CONCURRENT PROJECTS

- 2.3.1 The concurrent construction works that may be carried out include, but not limited to, the following:
  - (a) Regulation of Shenzhen River Stage IV;
  - (b) Widening of Fanling Highway Tai Hang to Wo Hop Shek Interchange Contract No. HY/2012/06;
  - (c) Construction of BCP facilities in Shenzhen.



#### 2.4 CONSTRUCTION PROGRESS

2.4.1 Following the partial commencement of the Project, the major construction works under the Project were substantially completed. Proposal for partial termination of the construction phase EM&A programme for Contracts 2, 4, 7 and SS C505 was approved by EPD on 9 July 2020 (EPD's ref.: () in Ax (3) to EP 2/N7/A/52 Pt.17). Moreover, termination proposal for Contract 3 was approved by EPD on 4 May 2021 (EPD's ref.: () in Ax (3) to EP 2/N7/A52 Pt.18).

#### Contract 6 (CV/2013/08)

- 2.4.2 Contract 6 has awarded in June 2015 and construction work was commenced on 23 October 2015. In this Reporting Period, construction activities conducted are listed below:
  - Maintenance works
  - Construction works near Kong Yiu Channel

#### 2.5 SUMMARY OF ENVIRONMENTAL SUBMISSIONS

- 2.5.1 In according to the EP, the required documents have submitted to EPD which listed in below:
  - Project Layout Plans of Contracts 2, 3, 4, 5, 6, 7 and SS C505
  - Landscape Plan
  - Topsoil Management Plan
  - Environmental Monitoring and Audit Programme
  - Baseline Monitoring Report (TCS00690/13/600/R0030v3) for the Project
  - Waste Management Plan of the Contracts 2, 3, 4, 5, 6, 7 and SS C505
  - Contamination Assessment Plan (CAP) and Contamination Assessment Report (CAR) for Po Kat Tsai, Loi Tung and the workshops in Fanling
  - Vegetation Survey Report
  - Woodland Compensation Plan
  - Habitat Creation and Management Plan
- 2.5.2 Summary of the relevant permits, licenses, and/or notifications on environmental protection for the Project of each contracts are presented in *Table 2-1*.

Table 2-1 Status of Environmental Licenses and Permits of the Contracts

Item	Description	License/Permit Status			
Item	Description	Ref. no.	Effective Date	Expiry Date	
		Contract 6			
1	Air pollution Control (Construction Dust) Regulation	Ref. No: 390614	29 Jun 2015	Till the end of Contract	
2	Chemical Waste Producer Registration	Waste Producers Number No.: 5213-652-C3969-01	31 Aug 2015	Till the end of Contract	
3	Water Pollution Control Ordinance - Discharge License	WT00041417-2022	20 Jun 2022	Valid until 30 Jun 2027	
4	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7022707	9 Jul 2015	Till the end of Contract	



# 3 SUMMARY OF IMPACT MONITORING REQUIREMENTS

#### 3.1 GENERAL

- 3.1.1 The Environmental Monitoring and Audit requirements are set out in the Approved EM&A manual. Environmental issues such as air quality, construction noise and water quality were identified as the key issues during the construction phase of the Project.
- 3.1.2 A summary of construction phase EM&A requirements are presented in the sub-sections below.

#### 3.2 MONITORING PARAMETERS

- 3.2.1 The EM&A program of construction phase monitoring shall cover the following environmental issues:
  - Air quality;
  - Construction noise; and
  - Water quality
- 3.2.2 A summary of the monitoring parameters is presented in *Table 3-1*.

**Table 3-1** Summary of EM&A Requirements

<b>Environmental Issue</b>	Parameters			
Air Quality	1-hour TSP by Real-Time Portable Dust Meter; and			
Air Quality	• 24-hour TSP by High Volume Air Sampler.			
	• L <sub>eq(30min)</sub> in normal working days (Monday to Saturday) 07:00-19:00			
	except public holiday; and			
Noise	• 3 sets of consecutive L <sub>eq(5min)</sub> on restricted hours i.e. 19:00 to 07:00			
NOISC	next day, and whole day of public holiday or Sunday			
	Supplementary information for data auditing, statistical results such			
	as $L_{10}$ and $L_{90}$ shall also be obtained for reference.			
	In-situ Measurements			
	<ul> <li>Dissolved Oxygen Concentration (mg/L);</li> </ul>			
	Dissolved Oxygen Saturation (% );			
	• Turbidity (NTU);			
Water Quality	pH unit;			
	Water depth (m); and			
	• Temperature (°C).			
	Laboratory Analysis			
	Suspended Solids (mg/L)			

# 3.3 MONITORING LOCATIONS

- 3.3.1 The designated monitoring locations as recommended in the *EM&A Manual* are shown in *Appendix D*. As the access to some of the designated monitoring locations was questionable due to safety reason or denied by the landlords, alternative locations therefore have had proposed. The latest alternative monitoring locations has been updated in the revised EM&A Programme (Rev.7) which approved by EPD on 7 April 2017. Besides, in view of Location AM1b was demolished and returned to the landlord on 27 April 2018, alterative location AM1c was proposed by ET and approved by EPD on 26 November 2018. *Table 3-2, Table 3-3 and Table 3-4* listed the air quality, construction noise and water quality monitoring locations for the Project and a map showing these monitoring stations is presented in *Appendix E*.
- 3.3.2 Following the proposal for partial termination of the construction phase EM&A programme for Contract 2, 4, 7 and SSC505 and Contract 3 was approved by EPD on 9 July 2020 and 4 May 2021 respectively. The corresponding air quality monitoring stations including AM1c, and AM8 were ceased after last monitoring carried out on 7 July 2020 and 10 July 2020 respectively and AM9b was ceased after last monitoring carried out on 4 May 2021. Besides, the



corresponding noise monitoring stations including NM1 and NM7 were ceased after last monitoring carried out on 7 July 2020 and 10 July 2020 respectively and NM8, NM9 and NM10 were ceased after last monitoring carried out on 29 April 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021. Moreover, WM4, WM4-CA and WM4-CB were ceased after last monitoring carried out on 3 May 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021.

**Table 3-2** Impact Monitoring Stations - Air Quality

Station ID	Description	Works Area	Related to the Work Contract
AM1c (*)	Open area of Tsung Yuen Ha Village	BCP	SS C505
(\$)	No. 63		Contract 7
AM2	Village House near Lin Ma Hang Road	LMH to Frontier	Contract 6
		Closed Area	
AM3	Ta Kwu Ling Fire Service Station of	LMH to Frontier	Contract 6
	Ta Kwu Ling Village.	Closed Area	
AM4b^	House no. 10B1 Nga Yiu Ha Village	LMH to Frontier	Contract 6
		Closed Area	
AM5a^	Ping Yeung Village House	Ping Yeung to	Contract 6
		Wo Keng Shan	
AM6	Wo Keng Shan Village House	Ping Yeung to	Contract 6
		Wo Keng Shan	
AM7b@	Loi Tung Village House	Sha Tau Kok	Contract 2
		Road	Contract 6
AM8 (\$)	Po Kat Tsai Village No. 4	Po Kat Tsai	Contract 2
AM9b#	Nam Wa Po Village House No. 80	Fanling	Contract 3

<sup>#</sup> Proposal for the change of air quality monitoring location from AM9a to AM9b was submitted to EPD on 4 Nov 2013 after verified by the IEC and it was approved by EPD (EPD's ref.: (15) in EP 2/N7/A/52 Pt.10 dated 8 Nov 2013). Besides, AM9b was ceased after last monitoring carried out on 4 May 2021 according to Partial Termination Proposal approved by EPD on 4 May 2021.

**Table 3-3** Impact Monitoring Stations - Construction Noise

Station ID	Description	Works Area	Related to the Work Contract
NM1 (\$)	Tsung Yuen Ha Village House No. 63	ВСР	SS C505 Contract 7
NM2a#	Village House near Lin Ma Hang Road	Lin Ma Hang to Frontier Closed Area	Contract 6
NM3	Ping Yeung Village House (facade facing northeast)	Ping Yeung to Wo Keng Shan	Contract 6
NM4	Wo Keng Shan Village House	Ping Yeung to Wo Keng Shan	Contract 6
NM5	Village House, Loi Tung	Sha Tau Kok Road	Contract 2, Contract 6

<sup>@</sup> Proposal for the change of air quality monitoring location from AM7a to AM7b was submitted to EPD on 4 June 2014 after verified by the IEC. It was approved by EPD (EPD's ref.: (7) in EP 2/N7/A/52 Pt.12 dated 9 Jun 2014).

<sup>^</sup> Proposal for change of air quality monitoring locations was enclosed in the updated EM&A Programme which approval by EPD on 29 Mar 2016. Besides, Location AMIb was temporary suspended (24-hour TSP monitoring) since 27 April 2018 as the rented land was demolished and returned to the landlord.

<sup>\*</sup> Revised proposal for alterative location AM1c was submitted to EPD on 31 October 2018 after verified by the IEC and it was approved by EPD (EPD's ref.: ( ) in Ax (1) to EP 2/N7/A/52 Pt.26 dated 26 November 2018).

<sup>\$</sup> AM1c and AM8 were ceased after last monitoring carried out on 7 July 2020 and 10 July 2020 respectively according to Partial Termination Proposal approved by EPD on 9 July 2020.



NM6	Tai Tong Wu Village House 2	Sha Tau Kok Road	Contract 2, Contract 6
NM7 (\$)	Po Kat Tsai Village	Po Kat Tsai	Contract 2
NM8 (\$)	Village House, Tong Hang	Fanling	Contract 2 Contract 3
NM9 (\$)	Village House, Kiu Tau Village	Fanling	Contract 3
NM10 (\$)	Nam Wa Po Village House No. 80	Fanling	Contract 3

<sup>#</sup> Proposal for the change of construction noise monitoring location from NM2 to NM2a was verified by the IEC on 6 May 2016 and was effective on 9 May 2016.

**Table 3-4** Impact Monitoring Stations - Water Quality

Station ID	Station ID Description		of Designated ve Location	Nature of the location	Related to the Work
		Easting	Northing		Contract
WM1	Downstream of Kong Yiu Channel	833 679	845 421	Alternative location located at upstream 51m of the designated location	Contract 6
WM1- Control	Upstream of Kong Yiu Channel	834 185	845 917	NA	Contract 6
WM2A	Downstream of River Ganges	834 204	844 471	Alternative location located at upstream 81m of the designated location	Contract 6
WM2A(a)*	Downstream of River Ganges	834 191	844 474	Alternative location located at upstream 70m of the designated location	Contract 6
WM2A- Controlx#	Upstream of River Ganges	835 377	844 188	Alternative location located at upstream 160m of the designated location	Contract 6
WM2B	Downstream of River Ganges	835 433	843 397	NA	Contract 6
WM2B- Control	Upstream of River Ganges	835 835	843 351	Alternative location located at downstream 31m of the designated location	Contract 6
WM3x#	Downstream of River Indus	836 206	842 270	Alternative location located at downstream 180m of the designated location	Contract 6
WM3- Control	Upstream of River Indus	836 763	842 400	Alternative location located at downstream 26m of the designated location	Contract 6
WM4 (\$)	Downstream of Ma Wat Channel	833 850	838 338	Alternative location located at upstream 11m of the designated location	Contract 3
WM4– Control A (\$)	Kau Lung Hang Stream	834 028	837 695	Alternative location located at downstream 28m of the designated location	Contract 3
WM4– Control B (\$)	Upstream of Ma Wat Channel	833760	837395	Alternative location located at upstream 15m of the designated location	Contract 3

Note: EPD has approved the revised EM&A Programme (Rev.7) which proposed that (1) if the measured water depth of the monitoring station is lower than 150 mm, alternative location based on the criteria were selected to perform water monitoring; and (2) If no suitable alternative location could be found within 15m far from the original location, the sampling at that location will be cancelled since sampling at too far from the designated location could not make a representative sample in accordance

<sup>\$</sup> NM1 and NM7 were ceased after last monitoring carried out on 7 July 2020 and 10 July 2020 respectively according to Partial Termination Proposal approved by EPD on 9 July 2020. Besides, NM8, NM9 and NM10 were ceased after last monitoring carried out on 29 April 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021.



- with the updated EM&A Programme (Rev. 07) (Section 4.1.4) (EPD ref.: ( ) in EP2/N7/A/52 Ax(1) Pt.20 dated 7 April 2017)
- (\*) Proposal for the change of water monitoring location from WM2A to WM2A(a) was verified by the IEC and it was approved by EPD. (EPD's ref. (10) in EP 2/N7/A/52 Pt.19)
- (#) Proposal for the change of water quality monitoring location (WM3x and WM2A-Cx was included in the EM&A Programme Rev .05 which approved by EPD on 29 March 2016 (EPD ref.: (3) in EP2/N7/A/52 Ax(1) Pt.19)
- (\$) WM4, WM4-CA and WM4-CB were ceased after last monitoring carried out on 3 May 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021.

## 3.4 MONITORING FREQUENCY AND PERIOD

The requirements of impact monitoring are stipulated in *Sections 2.1.6, 3.1.5* and *4.1.6* of the approved *EM&A Manual* and presented as follows.

# Air Quality Monitoring

- 3.4.1 Frequency of impact air quality monitoring is as follows:
  - 1-hour TSP 3 times every six days during course of works
  - 24-hour TSP Once every 6 days during course of works.

## Noise Monitoring

3.4.2 One set of  $L_{eq(30min)}$  as 6 consecutive  $L_{eq(5min)}$  between 0700-1900 hours on normal weekdays and once every week during course of works. If construction work necessary to carry out at other time periods, i.e. restricted time period (19:00 to 07:00 the next morning and whole day on public holidays) (hereinafter referred as "the restricted hours"), additional weekly impact monitoring for  $L_{eq(5min)}$  measurement shall be employed during respective restricted hours periods.. Supplementary information for data auditing, statistical results such as  $L_{10}$  and  $L_{90}$  shall also be obtained for reference.

# Water Quality Monitoring

3.4.3 The water quality monitoring frequency shall be 3 days per week during course of works. The interval between two sets of monitoring shall not be less than 36 hours.

### 3.5 MONITORING EQUIPMENT

## Air Quality Monitoring

- 3.5.1 The 24-hour and 1-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the *Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B*. If the ET proposes to use a direct reading dust meter to measure 1-hour TSP levels, it shall submit sufficient information to the IEC to approve.
- 3.5.2 The filter paper of 24-hour TSP measurement shall be determined by HOKLAS accredited laboratory.
- 3.5.3 All equipment to be used for air quality monitoring is listed in *Table 3-5*.

Table 3-5 Air Quality Monitoring Equipment

Equipment	Model				
	24-Hr TSP				
High Volume Air Sampler	TISCH High Volume Air Sampler, HVS Model TE-5170*				
Calibration Kit	TISCH Model TE-5025A*				
	1-Hour TSP				
Portable Dust Meter	Sibata LD-3B Laser Dust monitor Particle Mass Profiler &				
Fortable Dust Weter	Counter* / SidePak <sup>TM</sup> Personal Aerosol Monitor AM510*				

<sup>\*</sup> Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.



## Wind Data Monitoring Equipment

- 3.5.4 According to the approved EM&A Manual, wind data monitoring equipment shall also be provided and set up for logging wind speed and wind direction near the dust monitoring locations. The equipment installation location shall be proposed by the ET and agreed with the IEC. For installation and operation of wind data monitoring equipment, the following points shall be observed:
  - 1) The wind sensors should be installed 10 m above ground so that they are clear of obstructions or turbulence caused by buildings.
  - 2) The wind data should be captured by a data logger. The data shall be downloaded for analysis at least once a month.
  - 3) The wind data monitoring equipment should be re-calibrated at least once every six months.
  - 4) Wind direction should be divided into 16 sectors of 22.5 degrees each.
- 3.5.5 ET has liaised with the landlords of the successful granted HVS installation premises. However, the owners rejected to provide premises for wind data monitoring equipment installation.
- 3.5.6 Under this situation, the ET proposed alternative methods to obtain representative wind data. Meteorological information as extracted from "the Hong Kong Observatory Ta Kwu Ling Station" is alternative method to obtain representative wind data. For Ta Kwu Ling Station, it is located nearby the Project site. Moreover, this station is located at 15m above mean sea level while its anemometer is located at 13m above the existing ground which in compliance with the general setting up requirement. Furthermore, this station also can be to provide the humidity, rainfall, and air pressure and temperature etc. meteorological information. In Hong Kong of a lot development projects, weather information extracted from Hong Kong Observatory is common alternative method if weather station installation not allowed.

### Noise Monitoring

- 3.5.7 Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. The sound level meter shall be checked using an acoustic calibrator. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.
- 3.5.8 Noise monitoring equipment to be used for monitoring is listed in *Table 3-6*.

**Table 3-6** Construction Noise Monitoring Equipment

Equipment	Model
Integrating Sound Level Meter	Rion NL-52*
Calibrator	Rion NC-75*
Portable Wind Speed Indicator	Testo Anemometer

<sup>\*</sup> Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

3.5.9 Sound level meters listed above comply with the *International Electrotechnical Commission Publications 651: 1979 (Type 1)* and *804: 1985 (Type 1)* specifications, as recommended in TM issued under the NCO. The acoustic calibrator and sound level meter to be used in the impact monitoring will be calibrated yearly.

### Water Quality Monitoring

3.5.10 DO and water temperature should be measured in-situ by a DO/temperature meter. The instrument should be portable and weatherproof using a DC power source. It should have a membrane electrode with automatic temperature compensation complete with a cable. The equipment should be capable of measuring:



- a DO level in the range of 0-20 mg/l and 0-200% saturation; and
- a temperature of between 0 and 45 degree Celsius.
- 3.5.11 A portable pH meter capable of measuring a range between 0.0 and 14.0 should be provided to measure pH under the specified conditions accordingly to the APHA Standard Methods.
- 3.5.12 The instrument should be portable and weatherproof using a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0-1000 NTU.
- 3.5.13 A portable, battery-operated echo sounder or tape measure will be used for the determination of water depth at each designated monitoring station as appropriate.
- 3.5.14 A water sampler e.g. Kahlsico Water Sampler, which is a transparent PVC cylinder with capacity not less than 2 litres, will be used for water sampling if water depth over than 0.5m. For sampling from very shallow water depths e.g. <0.5 m, water sample collection will be directly from water surface below 100mm use sampling plastic bottle to avoid inclusion of bottom sediment or humus. Moreover, Teflon/stainless steel bailer or self-made sampling buckets maybe used for water sampling. The equipment used for sampling will be depended the sampling location and depth situations.
- 3.5.15 Water samples for laboratory measurement of SS will be collected in high density polythene bottles, packed in ice (cooled to 4 °C without being frozen), and delivered to the laboratory in the same day as the samples were collected.
- 3.5.16 Analysis of suspended solids should be carried out in a HOKLAS or other accredited laboratory. Water samples of about 1L should be collected at the monitoring stations for carrying out the laboratory suspended solids determination. The SS determination work should start within 24 hours after collection of the water samples. The SS analyses should follow the *APHA Standard Methods 2540D* with Limit of Reporting of 2 mg/L.
- 3.5.17 Water quality monitoring equipment used in the impact monitoring is listed in *Table 3-7*. Suspended solids (SS) analysis is carried out by a local HOKLAS-accredited laboratory, namely *ALS Technichem (HK) Pty Ltd*.

**Table 3-7** Water Quality Monitoring Equipment

Equipment	Model			
Water Depth Detector	Eagle Sonar or tape measures			
Water Sampler	A 2-litre transparent PVC cylinder with latex cups at both ends or teflon/stainless steel bailer or self-made sampling bucket			
Thermometer & DO meter	YSI Professional Plus/ YSI PRO20 Handheld Dissolved Oxygen Instrument/ YSI 550A Multifunctional Meter/ YSI Professional DSS*			
pH meter	YSI Professional Plus/ AZ8685 pH pen-style meter / YSI 6820/ 650MDS/ YSI Professional DSS*			
Turbidimeter	Hach 2100Q / YSI Professional DSS*			
Sample Container	High density polythene bottles (provided by laboratory)			
Storage Container	'Willow' 33-liter plastic cool box with Ice pad			

<sup>\*</sup> Instrument was used in the Reporting Period and the calibration certificate could be referred in Appendix F.

### 3.6 MONITORING METHODOLOGY

## 1-hour TSP Monitoring

3.6.1 The 1-hour TSP monitor was a brand named "Sibata LD-3B Laser Dust monitor Particle Mass Profiler & Counter" / "SidePak<sup>TM</sup> Personal Aerosol Monitor AM510" which is a portable,



battery-operated laser photometer. The 1-hour TSP meter provides a real time 1-hour TSP measurement based on 90° light scattering. The 1-hour TSP monitor consists of the following:

- (a.) A pump to draw sample aerosol through the optic chamber where TSP is measured;
- (b.) A sheath air system to isolate the aerosol in the chamber to keep the optics clean for maximum reliability; and
- (c.) A built-in data logger compatible with Windows based program to facilitate data collection, analysis and reporting.
- 3.6.2 The 1-hour TSP meter is used within the valid period as follow manufacturer's Operation and Service Manual.

## 24-hour TSP Monitoring

- 3.6.3 The equipment used for 24-hour TSP measurement is Tisch Environmental, Inc. Model TE-5170 TSP high volume air sampling system, which complied with *EPA Code of Federal Regulation, Appendix B to Part 50*. The High Volume Air Sampler (HVS) consists of the following:
  - (a.) An anodized aluminum shelter;
  - (b.) A 8"x10" stainless steel filter holder;
  - (c.) A blower motor assembly;
  - (d.) A continuous flow/pressure recorder;
  - (e.) A motor speed-voltage control/elapsed time indicator;
  - (f.) A 7-day mechanical timer, and
  - (g.) A power supply of 220v/50 Hz
- 3.6.4 The HVS is operated and calibrated on a regular basis in accordance with the manufacturer's instruction using Tisch Calibration Kit Model TE-5025A. Calibration would carry out in two month interval.
- 3.6.5 24-hour TSP is collected by the ET on filters of HVS and quantified by a local HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd (ALS), upon receipt of the samples. The ET keep all the sampled 24-hour TSP filters in normal air conditioned room conditions, i.e. 70% RH (Relative Humidity) and 25°C, for six months prior to disposal.

#### **Noise Monitoring**

- Noise measurements were taken in terms of the A-weighted equivalent sound pressure level ( $L_{eq}$ ) measured in decibels dB(A). Supplementary statistical results ( $L_{10}$  and  $L_{90}$ ) were also obtained for reference.
- 3.6.7 During the monitoring, all noise measurements would be performed with the meter set to FAST response and on the A-weighted equivalent continuous sound pressure level ( $L_{eq}$ ).  $Leq_{(30min)}$  in six consecutive  $Leq_{(5min)}$  measurements will use as the monitoring parameter for the time period between 0700-1900 hours on weekdays;  $Leq_{(5min)}$  measurements would be used as monitoring parameter for other time periods (e.g. during restricted hours), if necessary.
- 3.6.8 Prior of noise measurement, the accuracy of the sound level meter is checked using an acoustic calibrator generating a known sound pressure level at a known frequency. The checking is performed before and after the noise measurement.

## Water Quality

3.6.9 Water quality monitoring is conducted at the designated or alternative locations. The sampling procedures with the in-situ monitoring are presented as below:

Sampling Procedure

3.6.10 A Digital Global Positioning System (GPS) is used to identify the designated monitoring stations



prior to water sampling. A portable, battery-operated echo sounder or tape measurement is used for the determination of water depth at each station. At each station, water sample would be collected from 0.1m below water surface or the water surface to prevent the river bed sediment for stirring.

- 3.6.11 If the water level of a monitoring station is too shallow when sampling, sediment would be disturbed which affecting the accuracy of water quality monitoring. In order to avoid disturbing sediment, depth limits should be set up for the water sampling for the ease of reference. When the measured water depth of the monitoring station (both control and impact stations) is lower than 150mm, water monitoring would not be to perform at that monitoring location. Instead, the monitoring location will be moved to a temporary alternative location monitoring location based on the criteria below:-
  - (a) the alternative location should be either upstream or downstream of the original location and at the same the river/drain channel
  - (b) the alternative location should be within 15m far from the original location
  - (c) if no suitable alternative location could be found within 15m far from the original location, the sampling at that location will be cancelled since sampling at too far from the designated location could not make a representative sample.
- 3.6.12 The sample container will be rinsed with a portion of the water sample. The water sample then will be transferred to the high-density polythene bottles as provided by the laboratory, labeled with a unique sample number and sealed with a screw cap.
- 3.6.13 Before sampling, general information such as the date and time of sampling, weather condition as well as the personnel responsible for the monitoring would be recorded on the field data sheet.
- 3.6.14 A 'Willow' 33-liter plastic cool box packed with ice will be used to preserve the water samples prior to arrival at the laboratory for chemical determination. The water temperature of the cool box is maintained at a temperature as close to 4°C as possible without being frozen. Samples collected are delivered to the laboratory upon collection.

## In-situ Measurement

- 3.6.15 YSI Professional DSS is used for water in-situ measures, which automates the measurements and data logging of temperature, dissolved oxygen and dissolved oxygen saturation.
- 3.6.16 YSI Professional DSS is used for in-situ pH measurement. The pH meter is capable of measuring pH in the range of 0-14 and readable to 0.1.
- 3.6.17 YSI Professional DSS is used for in-situ turbidity measurement. The turbidity meter is capable of measuring turbidity in the range of 0 1000 NTU.
- 3.6.18 All in-situ measurement equipment are calibrated by HOKLAS accredited laboratory of three month interval.

# Laboratory Analysis

3.6.19 All water samples analyzed Suspended Solids (SS) will be carried out by a local HOKLAS-accredited testing laboratory (ALS Technichem (HK) Pty Ltd HOKLAS registration no. 66). SS determination using *APHA Standard Methods 2540D* as specified in the *EM&A Manual* will start within 48 hours of water sample receipt.

## 3.7 EQUIPMENT CALIBRATION

3.7.1 Calibration of the HVS is performed upon installation and thereafter at bimonthly intervals in accordance with the manufacturer's instruction using the certified standard calibrator (TISCH



Model TE-5025A). Moreover, the Calibration Kit would be calibrated annually. The calibration data are properly documented and the records are maintained by ET for future reference.

- 3.7.2 The 1-hour TSP meter was calibrated by the supplier prior to purchase. Zero response of the equipment would be checked before and after each monitoring event. Annually calibration with the High Volume Sampler (HVS) in same condition would be undertaken by the Laboratory.
- 3.7.3 The sound level meter and calibrator are calibrated and certified by a laboratory accredited under HOKLAS or any other international accreditation scheme at yearly basis.
- 3.7.4 All water quality monitoring equipment would be calibrated by HOKLAS accredited laboratory of three month intervals.
- 3.7.5 The calibration certificates of all monitoring equipment used for the impact monitoring program in the Reporting Period and the HOKLAS accredited certificate of laboratory are attached in *Appendix F*.

## 3.8 DERIVATION OF ACTION/LIMIT (A/L) LEVELS

3.8.1 The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. According to the approved Environmental Monitoring and Audit Manual, the air quality, construction noise and water quality criteria were set up, namely Action and Limit levels are listed in *Tables 3-8*, *3-9* and *3-10*.

Table 3-8 Action and Limit Levels for Air Quality Monitoring

Manitaring Station	Action 1	Level (μg/m³)	Limit l	Level (µg/m³)	
Monitoring Station	1-hour TSP	24-hour TSP	1-hour TSP	24-hour TSP	
AM1c (\$)	265	143			
AM2	268	149			
AM3	269	145			
AM4b	267	148			
AM5a	268	143	500	260	
AM6	269	148			
AM7b	275	156			
AM8 (\$)	269	144			
AM9b (\$)	271	151			

\$ AMIc and AM8 were ceased after last monitoring carried out on 7 July 2020 and 10 July 2020 respectively according to Partial Termination Proposal approved by EPD on 9 July 2020. Besides, AM9b was ceased after last monitoring carried out on 4 May 2021 according to Partial Termination Proposal approved by EPD on 4 May 2021.

Table 3-9 Action and Limit Levels for Construction Noise

Monitoring Location	Action Level	Limit Level in dB(A)			
Withintoning Location	Time Period: 0700-1900 hours on normal weekdays				
NM1(\$), NM2a, NM3, NM4, NM5, NM6, NM7(\$), NM8(\$), NM9(\$), NM10(\$)	When one or more documented complaints are received	75 dB(A) <sup>Note 1 &amp; Note 2</sup>			

Note 1: Acceptable Noise Levels for school should be reduced to 70 dB(A) and 65 dB(A) during examination period.

Note 2: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.

\$ NM1 and NM7 were ceased after last monitoring carried out on 7 July 2020 and 10 July 2020 respectively according to Partial Termination Proposal approved by EPD on 9 July 2020. Besides, NM8, NM9 and NM10 were ceased after last monitoring carried out on 29 April 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021.



Table 3-10 Action and Limit Levels for Water Quality

Dayamatay	Performance	Monitoring Location						
Parameter	criteria	WM1	WM2A(a)	WM2B	WM3x	WM4(\$)		
DO	Action Level	(*)4.23	(**)4.00	(*)4.74	(**)4.00	(*)4.14		
(mg/L)	Limit Level	(#)4.19	(**)4.00	<sup>(#)</sup> 4.60	(**)4.00	(#)4.08		
Turbidity	Action Level	51.3	24.9 11.4 13.4 35.2					
	Action Level	AND	120% of upstream control station of the same day					
(NTU)	Limit Level	67.6	33.8	12.3	14.0	38.4		
	Lillill Level	AND	130% of ups	tation of the sa	ame day			
	Action Level	54.5	14.6	11.8	12.6	39.4		
CC (/II)	Action Level	AND	120% of upstream control station of the same day					
SS (mg/L)	T :1	64.9	17.3 12.4 12.9 45.5					
	Limit Level	AND	130% of ups	tream control s	tation of the sa	ame day		

#### Remarks:

- (\*) The Proposed <u>Action Level</u> of Dissolved Oxygen is adopted to be used 5%-ile of baseline data (\*\*) The Proposed Action & Limit Level of Dissolved Oxygen is used 4mg/L
- (#) The Proposed <u>Limit Level</u> of Dissolved Oxygen is adopted to be used 1%-ile of baseline data (\$) WM4, WM4-CA and WM4-CB were ceased after last monitoring carried out on 3 May 2021 according to Partial Termination Proposal for Contract 3 approved by EPD on 4 May 2021.
- 3.8.2 Should non-compliance of the environmental quality criteria occurs, remedial actions will be triggered according to the Event and Action Plan which presented in *Appendix G*.

## 3.9 DATA MANAGEMENT AND DATA QA/QC CONTROL

- 3.9.1 All monitoring data will be handled by the ET's in-house data recording and management system. The monitoring data recorded in the equipment will be downloaded directly from the equipment at the end of each monitoring day. The downloaded monitoring data will input into a computerized database maintained by the ET. The laboratory results will be input directly into the computerized database and checked by personnel other than those who input the data.
- 3.9.2 For monitoring parameters that require laboratory analysis, the local laboratory shall follow the QA/QC requirements as set out under the HOKLAS scheme for the relevant laboratory tests.



## 4 AIR QUALITY MONITORING

### 4.1 GENERAL

- 4.1.1 Proposal for partial termination of the construction phase EM&A programme for Contract 2, Contract 4, Contract 7 and Contract SS C505 was approved by EPD on 9 July 2020 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.17). The Partial termination proposal for Contract 3 was approved by EPD on 4 May 2021 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.18). The corresponding air quality monitoring stations AM1c, AM8 and AM9b ceased accordingly, while monitoring at other monitoring stations continued in the Reporting Period.
- 4.1.2 The air quality monitoring schedule is presented in *Appendix H* and the monitoring results are summarized in the following sub-sections.

# 4.2 AIR QUALITY MONITORING RESULTS

4.2.1 In the Reporting Period, a total of **90** events of 1-hour TSP and **30** events 24-hours TSP monitoring were carried out and the monitoring results are summarized in **Tables 4-1 to 4-6**. The detailed 24-hour TSP monitoring data are presented in **Appendix I** and the relevant graphical plots are shown in **Appendix J**.

Table 4-1 Summary of 24-hour and 1-hour TSP Monitoring Results – AM2

	24-hour TSP		1	g/m <sup>3</sup> )		
Date $ \frac{24 - \text{Hour 131}}{(\mu \text{g/m}^3)} $	Date	Start Time	1st reading	2 <sup>nd</sup> reading	3 <sup>rd</sup> reading	
6-Jul-22	43	4-Jul-22*	13:24	76	58	63
12-Jul-22	39	8-Jul-22	11:08	93	102	98
18-Jul-22	41	14-Jul-22	10:18	96	86	88
23-Jul-22	64	20-Jul-22	9:44	43	46	44
29-Jul-22	90	26-Jul-22	10:04	93	81	94
Average	55	Averag	ge	77		
(Range)	(39 - 90)	(Rang	e)	(43 – 102)		

<sup>\*</sup>I-Hour TSP monitoring at AM2&3 on 2 July 2022 were cancelled due to adverse weather condition (Typhoon Signal No. 8 in force). The 1-hour TSP monitoring at AM2&3 was rescheduled to 4 July 2022.

Table 4-2 Summary of 24-hour and 1-hour TSP Monitoring Results – AM3

	24-hour		1-hour TSP (μg/m³)			
Date	TSP (μg/m³)	Date	Start Time	1 <sup>st</sup> reading	2 <sup>nd</sup> reading	3 <sup>rd</sup> reading
6-Jul-22	28	4-Jul-22*	13:31	57	68	70
12-Jul-22	28	8-Jul-22	11:03	38	43	45
18-Jul-22	42	14-Jul-22	10:13	61	48	57
23-Jul-22	55	20-Jul-22	9:33	47	51	49
29-Jul-22	74	26-Jul-22	10:00	62	68	47
Average	45	Averag	ge		54	
(Range)	(28 - 74)	(Rang	e)	(38-70)		

<sup>\*1-</sup>Hour TSP monitoring at AM2&3 on 2 July 2022 were cancelled due to adverse weather condition (Typhoon Signal No. 8 in force). The 1-hour TSP monitoring at AM2&3 was rescheduled to 4 July 2022.

Table 4-3 Summary of 24-hour and 1-hour TSP Monitoring Results – AM4b

	24-hour		1-hour TSP (μg/m³)				
Date	TSP (μg/m³)	Date	Start Time	1st reading	2 <sup>nd</sup> reading	3 <sup>rd</sup> reading	
2-Jul-22	14	4-Jul-22	9:28	43	46	44	
8-Jul-22	15	9-Jul-22	9:32	74	68	61	



	24-hour	1-hour TSP (μg/m³)				
Date	TSP (μg/m³)	Date	Start Time	1 <sup>st</sup> reading	2 <sup>nd</sup> reading	3 <sup>rd</sup> reading
14-Jul-22	15	15-Jul-22	9:30	93	90	98
20-Jul-22	36	21-Jul-22	9:28	58	70	73
26-Jul-22	15	27-Jul-22	9:46	56	58	64
Average (Range)	19 (14 – 36)	Average (Range)		66 (43 – 98)		

Table 4-4 Summary of 24-hour and 1-hour TSP Monitoring Results – AM5a

	24-hour	1-hour TSP (μg/m³)				
Date	TSP (μg/m³)	Date	Start Time	1 <sup>st</sup> reading	2 <sup>nd</sup> reading	3 <sup>rd</sup> reading
2-Jul-22	15	4-Jul-22	9:15	44	48	52
8-Jul-22	13	9-Jul-22	9:35	96	89	75
14-Jul-22	16	15-Jul-22	9:38	63	75	78
20-Jul-22	11	21-Jul-22	9:32	70	73	67
26-Jul-22	20	27-Jul-22	9:58	83	75	86
Average	15	Average		72		
(Range)	(11-20)	(Rang	ge)		(44 - 96)	

Table 4-5 Summary of 24-hour and 1-hour TSP Monitoring Results – AM6

	24-hour		g/m³)				
Date	TSP (μg/m³)	Date Start Time 1st reading		2 <sup>nd</sup> reading	3 <sup>rd</sup> reading		
2-Jul-22	17	4-Jul-22	10:00	52	56	48	
8-Jul-22	24	9-Jul-22	9:44	92	83	96	
14-Jul-22	37	15-Jul-22	9:52	90	74	81	
20-Jul-22	27	21-Jul-22	9:42	79	74	67	
26-Jul-22	55	27-Jul-22	10:10	86	75	83	
Average	32	Avera	ige	76			
(Range)	(17 - 55)	(Rang	ge)	(48 – 96)			

Table 4-6 Summary of 24-hour and 1-hour TSP Monitoring Results – AM7b

	24-hour	1-hour TSP (μg/m³)					
Date	TSP (μg/m³)	Date Start Time 1st reading		2 <sup>nd</sup> reading	3 <sup>rd</sup> reading		
2-Jul-22	16	4-Jul-22	10:15	42	41	40	
8-Jul-22	19	9-Jul-22	9:52	81	76	88	
14-Jul-22	19	15-Jul-22	10:00	83	85	86	
20-Jul-22	18	21-Jul-22	10:03	88	93	85	
26-Jul-22	27	27-Jul-22	10:26	77	68	84	
Average	20	Avera	age <b>74</b>				
(Range)	(16-27)	(Rang	ge)	(40–93)			

- 4.2.2 As shown in *Tables 4-1 to 4-6*, all the 1-hour and 24-hour TSP monitoring results were below the Action/Limit Levels. No Notification of Exceedance (NOE) was issued in this Reporting Period.
- 4.2.3 The meteorological data during the impact monitoring days are summarized in *Appendix K*.



### 5 CONSTRUCTION NOISE MONITORING

#### 5.1 GENERAL

- 5.1.1 Proposal for partial termination of the construction phase EM&A programme for Contract 2, Contract 4, Contract 7 and Contract SS C505 was approved by EPD on 9 July 2020 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.17). The Partial termination proposal for Contract 3 was approved by EPD on 4 May 2021 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.18). The corresponding noise quality monitoring stations NM1, NM7, NM8, NM9 and NM10 ceased accordingly, while monitoring at other monitoring stations continued in the Reporting Period.
- 5.1.2 The noise monitoring schedule is presented in Appendix H and the monitoring results are summarized in the following sub-sections.

#### 5.2 Noise Monitoring Results

5.2.1 In the Reporting Period, a total of **20** events noise measurements were carried out at the designated locations. The sound level meter was set in 1m from the exterior of the building façade including noise monitoring locations NM3, NM4, NM5, and NM6. Therefore, no façade correction (+3 dB(A)) is added according to acoustical principles and EPD guidelines. However, free-field status were performed at NM2a and façade correction (+3 dB(A)) has added according to the requirement in this month. The noise monitoring results at the designated locations are summarized in *Tables 5-1 and 5-2*. The detailed noise monitoring data are presented in *Appendix I* and the relevant graphical plots are shown in *Appendix J*.

Table 5-1 Summary of Construction Noise Monitoring Results

Construc	Construction Noise Level (Leq30min), dB(A)				
Date	NM2a(*)				
8-Jul-22	63				
14-Jul-22	65				
20-Jul-22	65				
26-Jul-22	62				
Limit Level	75 dB(A)				

Remarks

**Table 5-2 Summary of Construction Noise Monitoring Results** 

Construction Noise Level (Leq30min), dB(A)									
Date NM3 NM4 NM5 NM6									
4-Jul-22	61	69	51	56					
15-Jul-22	61	58	52	57					
21-Jul-22	62	65	52	59					
27-Jul-22	62	65	55	57					
Limit Level	Limit Level 75 dB(A)								

5.2.2 As shown in *Tables 5-1 and 5-2*, no construction noise measurement results that exceeded the Limit Level were recorded. Moreover, no valid noise complaint (which triggered Action Level exceedance) was recorded in the Reporting Period.

<sup>(\*)</sup> façade correction  $(+3 \, dB(A))$  is added according to acoustical principles and EPD guidelines.



# 6 WATER QUALITY MONITORING

#### 6.1 GENERAL

- 6.1.1 Proposal for partial termination of the construction phase EM&A programme for Contract 2, Contract 4, Contract 7 and Contract SS C505 was approved by EPD on 9 July 2020 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.17). The Partial termination proposal for Contract 3 was approved by EPD on 4 May 2021 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.18). The corresponding monitoring stations WM4, WM4-CA and WM4-CB ceased accordingly, while monitoring at other monitoring stations in the Reporting Period.
- 6.1.2 In the Reporting Period, water quality monitoring was performed at the designated locations related to Contracts 6. The water quality monitoring schedule is presented in *Appendix H*. The monitoring results are summarized in the following sub-sections.

# 6.2 RESULTS OF WATER QUALITY MONITORING

6.2.1 In the Reporting Period, Water Quality Monitoring on 2 July 2022 were cancelled due to adverse weather condition (Typhoon Signal No. 8 in force). A total of **twelve (12)** sampling days were scheduled to carry out for other monitoring locations with their control stations. The key monitoring parameters including Dissolved Oxygen, Turbidity and Suspended Solids are summarized in *Tables 6-1 to 6-3*. Breaches of water quality monitoring criteria are shown in *Table 6-4*. Detailed monitoring database including in-situ measurements and laboratory analysis data are shown in *Appendix I* and the relevant graphical plot are shown in *Appendix J*.

Table 6-1 Water Quality Monitoring Results Associated Contracts 6

Date	Dissolved (mg	l Oxygen g/L)		oidity ΓU)	Suspended Solids (mg/L)		
	WM1	WM1-C	WM1	WM1-C	WM1	WM1-C	
4-Jul-22	7.4	5.4	35.3	130.5	38.5	130.0	
6-Jul-22	6.6	4.6	49.3	66.7	94.0	85.0	
8-Jul-22	7.3	7.2	50.5	12.3	53.0	10.5	
11-Jul-22	7.5	7.6	30.2	10.3	40.5	5.0	
13-Jul-22	7.5	8.1	47.9	31.8	56.0	63.0	
15-Jul-22	7.2	8.3	100.0	128.0	123.5	219.5	
18-Jul-22	7.3	7.6	71.8	70.2	101.0	88.0	
20-Jul-22	7.1	7.5	117.0	210.5	151.0	438.5	
22-Jul-22	7.7	7.7	43.7	66.5	37.5	67.5	
25-Jul-22	7.4	8.1	40.1	13.7	43.5	14.5	
27-Jul-22	7.8	*	36.8	*	30.5	*	
29-Jul-22	7.3	*	25.3	*	53.0	*	

Remarks: \* water sampling was unable to carry out at WM1-C due to shallow water (water depth under 150mm)

Table 6-2 Water Quality Monitoring Results Associated Contract 6

	]	Dissolve (m	ed Oxyg g/L)	en		Turbi (NT	•		Suspended Solids (mg/L)			
Date	WM2 A(a)	WM2 A- Cx	WM2 B	WM2B-	WM2A( a)	WM2 A- Cx		WM2 B- C	WM2 A(a)	WM2A - Cx	WM2 B	W M2 B- C
4-Jul-22	7.0	7.1	*	*	6.9	6.2	*	*	6.5	11.5	*	*
6-Jul-22	7.5	7.2	*	*	20.0	7.1	*	*	13.5	12.0	*	*
8-Jul-22	7.3	7.6	*	*	11.5	212.0	*	*	11.5	301.5	*	*
11-Jul-22	6.5	6.8	*	*	13.6	170.6	*	*	7.5	233.0	*	*
13-Jul-22	6.4	6.7	*	*	8.4	163.0	*	*	10.0	287.0	*	*
15-Jul-22	6.1	6.5	*	*	22.7	132.5	*	*	26.0	244.5	*	*
18-Jul-22	5.9	7.0	*	*	8.9	7.4	*	*	8.5	16.0	*	*



	Dissolved Oxygen (mg/L)					Turbi (NT)	•		Suspended Solids (mg/L)			
Date	WM2 A(a)	WM2 A- Cx	WM2 B	WM2B- C	WM2A( WM2 WM2 WM2 A- Cx B B- C				WM2 A(a)	WM2A - Cx	WM2 B	W M2 B- C
20-Jul-22	6.1	7.0	*	*	15.4	5.5	*	*	19.0	16.5	*	*
22-Jul-22	6.3	7.2	*	*	8.7	6.3	*	*	4.5	13.0	*	*
25-Jul-22	6.9	6.8	*	*	7.3	5.9	*	*	3.5	12.5	*	*
27-Jul-22	6.4	6.9	*	*	7.9	5.1	*	*	6.5	7.5	*	*
29-Jul-22	6.6	6.8	*	*	7.3	4.9	*	*	5.5	8.0	*	*

Remarks: \* water sampling was unable to carry out at WM2B and WM2B-C due to shallow water (water depth under 150mm)

Table 6-3 Water Quality Monitoring Results Associated Contracts 6

Date		d Oxygen g/L)	Turbidity (NTU)		_	ed Solids g/L)
	WM3x	WM3-C	WM3x	WM3-C	WM3x	WM3-C
4-Jul-22	7.2	6.6	11.5	8.6	13.0	11.0
6-Jul-22	7.2	6.8	56.7	244.0	81.0	402.5
8-Jul-22	7.6	7.0	3.6	11.9	7.0	22.5
11-Jul-22	7.6	5.6	4.0	9.9	4.0	5.5
13-Jul-22	7.8	*	3.9	*	5.5	*
15-Jul-22	8.0	*	4.5	*	6.0	*
18-Jul-22	7.9	*	3.7	*	4.5	*
20-Jul-22	7.9	*	3.1	*	4.0	*
22-Jul-22	7.9	*	3.9	*	7.5	*
25-Jul-22	8.0	*	5.3	*	2.5	*
27-Jul-22	7.9	*	3.6	*	8.5	*
29-Jul-22	8.3	*	3.0	*	10.0	*

Remarks: \* water sampling was unable to carry out at WM3-C due to shallow water (water depth under 150mm)

Table 6-4 Action and Limit (A/L) Levels Exceedance Recorded

Location		olved ygen	Turk	oidity	_	ended lids	Total Exceedance		Project Related exceedance	
	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL
WM1	0	0	0	0	0	0	0	0	0	0
WM2A(a)	0	0	0	0	0	0	0	0	0	0
WM2B	0	0	0	0	0	0	0	0	0	0
WM3x	0	0	0	0	0	0	0	0	0	0
No of Exceedance	0	0	0	0	0	0	0	0	0	0

6.2.2 In this Reporting Period, no exceedance was recorded for water quality monitoring. No corrective measure was therefore required.



#### 7 ECOLOGY MONITORING

#### 7.1 MONITORING ON WOODLAND COMPENSATION

- 7.1.1 According to the approved Woodland Compensation Plan (WCP), ecological monitoring for woodland compensation shall be conducted at bi-monthly interval for the first year and the monitoring frequency would be reduced to quarterly from the second year.
- 7.1.2 As Stage 2 of the enhancement planting work was undertaken in August 2019 has covered all of the 9 monitoring quadrats. The bi-monthly was conducted in the first year after Stage 2 of enhancement planting and the monitoring frequency would be reduce to quarterly from the second year.
- 7.1.3 The quarterly ecological monitoring for period of June to August 2021 had carried out on 22 and 23 July 2021 by transects inspection and quadrat monitoring. The quarterly Ecological Monitoring Report was verified by IEC on 7 October 2021 and it has been submitted as a stand-alone copy to supplement the EM&A Report on 7 October 2021.
- 7.1.4 The monitoring for woodland compensation was completed in August 2021 as the last monitoring according to the approved WCP. The details of findings could refer to the corresponding Quarterly Ecological Monitoring Report. As advised by the AECOM, the Woodland Compensation Area had been handed over to AFCD after their acceptance of Initial Planting and Enhancement Planting Works, which include the last replanting works in September 2021.

#### 7.2 MONITORING ON WETLAND COMPENSATION

- 7.2.1 According to the approved Habitat Creation and Management Plan (HCMP), the proposed Wetland Compensation Area (WCA) near the Ping Yeung Interchange adjacent to the section of Ping Yuen River was adopted. Ecological monitoring at implementation and establishment periods of WCA will be conducted to cover the ecological attributes. Implementation of the wetland will commence within the construction phase after completion of the construction works at Ping Yeung Section. Monitoring on the WCA will be conducted in implementation and establishment stages.
- 7.2.2 Monitoring of WCA at establishment stage has been conducted for one year duration according to the approved HCMP. The establishment stage of wetland was commenced on 1st October 2020 and report (September 2021) was the last monitoring report for the Wetland Compensation Area. The monitoring results of ecology and water quality are generally in order, and no follow up measures under the EM&A is required. After establishment stage, AFCD would be responsible of maintenance and the monitoring works. As advised by the AECOM, the handover issue with AFCD is under processing.
- 7.2.3 The revision of HCMP Rev 4.0 prepared by AECOM and has been certified by ETL and verified by IEC on 9 December 2021 and re-submitted to EPD on 16 December 2021 and EPD had no comment on HCMP Rev 4.0 on 1 March 2022.



#### 8 WASTE MANAGEMENT

#### 8.1 GENERAL WASTE MANAGEMENT

8.1.1 Waste management was carried out in accordance with the Waste Management Plan (WMP) for contract 6.

## 8.2 RECORDS OF WASTE QUANTITIES

- 8.2.1 All types of waste arising from the construction work are classified into the following:
  - Construction & Demolition (C&D) Material;
  - Chemical Waste;
  - General Refuse; and
  - Excavated Soil.
- 8.2.2 The quantities of waste for disposal in this Reporting Period are summarized in *Tables 8-1* and 8-2 and the Monthly Summary Waste Flow Table is shown in *Appendix L*. Whenever possible, materials were reused on-site as far as practicable.

Table 8-1 Summary of Quantities of Inert C&D Materials for the Project

TorresCAN	Contract 6			
Type of Waste	Quantity	Disposal location		
C&D Materials (Inert) (in '000m <sup>3</sup> )	0			
Reused in this Contract (Inert) (in '000 m <sup>3</sup> )	0			
Reused in other Contracts/ Projects (Inert) (in '000 m <sup>3</sup> )	0			
Disposal as Public Fill (Inert) (in '000 m <sup>3</sup> )	0			

Table 8-2 Summary of Quantities of C&D Wastes for the Project

The CANA	Co	ontract 6
Type of Waste	Quantity	Disposal location
Recycled Metal ('000kg)	0	
Recycled Paper / Cardboard Packing ('000kg)	0	
Recycled Plastic ('000kg)	0	
Chemical Wastes ('000kg)	0	
General Refuses ('000m <sup>3</sup> )	0.007	NENT



### 9 SITE INSPECTION

#### 9.1 REQUIREMENTS

- 9.1.1 According to the approved EM&A Manual, the environmental site inspection shall be formulation by ET Leader. Weekly environmental site inspections should carry out to confirm the environmental performance.
- 9.1.2 Proposal for partial termination of the construction phase EM&A programme for Contract 2, Contract 4, Contract 7 and Contract SS C505 was approved by EPD on 9 July 2020 (EPD's ref.:

  in Ax (3) to EP 2/N7/A/52 Pt.17). The ET's site inspection and audit for corresponding Contract 2, 4, 7 and SS C505 were ceased after last site inspection undertaken on 10 July 2020.
- 9.1.3 The Partial termination proposal for Contract 3 was approved by EPD on 4 May 2021 (EPD's ref.: ( ) in Ax (3) to EP 2/N7/A/52 Pt.18). The ET's site inspection and audit for Contract 3 was ceased after last site inspection undertaken on 5 May 2021.

## 9.2 FINDINGS / DEFICIENCIES DURING THE REPORTING MONTH

## Contract 6

- 9.2.1 In the Reporting Period, joint site inspection has been carried out by ET and the Contractor on 7, 14, 21 and 28 July 2022. Joint site inspection with the RE, ET, IEC and the Contractor was carried out on 28 July 2022. No non-compliance was noted.
- 9.2.2 The findings / deficiencies of *Contract 6* that observed during the weekly site inspection are listed in *Table 9-1*.

**Table 9-1 Site Observations for Contract 6** 

Date	Findings / Deficiencies	Follow-Up Status
7 July 2022	No adverse environmental issue was observed.	• NA
14 July 2022	No adverse environmental issue was observed.	• NA
21 July 2022	No adverse environmental issue was observed.	• NA
28 July 2022	No adverse environmental issue was observed.	• NA

9.2.3 General housekeeping such as daily site tidiness and cleanliness should be maintained for all Contracts. Furthermore, the Contractors were reminded to implement Waste Management Plan of the Project.



# 10 ENVIRONMENTAL COMPLAINT AND NON-COMPLIANCE

## 10.1 Environmental Complaint, Summons and Prosecutions

- 10.1.1 In the Reporting Period, no environmental complaint was recorded.
- 10.1.2 No summons and prosecution under the EM&A Programme was lodged for all Contracts.
- 10.1.3 The statistical summary of environmental complaint is presented in *Tables 10-1*, *10-2* and *10-3*. The complaint log for the Project is shown in *Appendix O*.

Table 10-1 Statistical Summary of Environmental Complaints

Reporting	Contract No	Environmental Complaint Statistics			Project related
Period		Frequency	Cumulative	Complaint Nature	complaint
16 Aug 2013 – 30 June 2022	Contract 6	0	46	<ul> <li>(24) Water Quality</li> <li>(12) Dust</li> <li>(3) Noise</li> <li>(1) Nuisance</li> <li>(2) Noise and dust</li> <li>(3) Water quality and dust</li> <li>(1) Water quality and noise</li> </ul>	(8) water quality (3) dust (1) nuisance (1) water quality and dust (1) water quality and noise
1 – 31 July 2022	Contract 6	0	46	<ul> <li>(24) Water Quality</li> <li>(12) Dust</li> <li>(3) Noise</li> <li>(1) Nuisance</li> <li>(2) Noise and dust</li> <li>(3) Water quality and dust</li> <li>(1) Water quality and noise</li> </ul>	NA

Table 10-2 Statistical Summary of Environmental Summons

Danautina Dania d	Combract No.	<b>Environmental Summons Statistics</b>		
Reporting Period	Contract No	Frequency	Cumulative	Complaint Nature
16 Aug 2013 – 30 June 2022	Contract 6	0	0	NA
1 – 31 July 2022 Contract 6		0	0	NA

Table 10-3 Statistical Summary of Environmental Prosecutions

Donouting Dovied	Contract No.	<b>Environmental Prosecutions Statistics</b>		
Reporting Period	Contract No	Frequency	Cumulative	Complaint Nature
16 Aug 2013 – 30 June 2022	Contract 6	0	0	NA
1 – 31 July 2022	Contract 6	0	0	NA



#### 11 IMPLEMENTATION STATUS OF MITIGATION MEASURES

#### 11.1 GENERAL REQUIREMENTS

11.1.1 The environmental mitigation measures that recommended in the Implementation Schedule for Environmental Mitigation Measures (ISEMM) in the approved EM&A Manual covered the issues of dust, noise, water and waste and they are summarized presented in *Appendix M*.

## Implementation of Mitigation Measures during Construction Phase

11.1.2 Contract 6 under the Project shall be implementing the required environmental mitigation measures according to the approved EM&A Manual as subject to the site condition. Environmental mitigation measures have been generally implemented by Contract 6 according to the ISEMM, where applicable.

## Implementation of Mitigation Measures during Operation Phase

- 11.1.3 The Heung Yuen Wai (HYW) Highway and connecting roads under the Project was opened on 26 May 2019. Since partial commencement of operation is the same as the commencement of operation for the entire project from EIAO perspective. All relevant requirements as stipulated in the EP and the approved EIA report (including the EM&A Manual) for the commencement of operation of the Project shall be strictly complied with.
- 11.1.4 In general, the recommended mitigation measures for operation stage of HYW Highway and connecting roads under the Project have been implemented. The implementation status of mitigation measures for operation phase in the Reporting Period are summarized in *Appendix N*.
- 11.1.5 For more details about the implementation status of mitigation measures for operation phase with photo illustration, an Environmental Monitoring and Audit report on the implementation of the mitigation measures for operation stage of the Project will be disposed to EPD not later than three months after the commencement of operation of the Project under EP-404/2011/D condition 5.5. The abovementioned report was submitted to EPD on 23 August 2019.
- 11.1.6 Upon BCP partially opened on 26 August 2020, an operation phase EM&A report covering the operation of the BCP (Version 3) was subsequently submitted to EPD in accordance with the EP-404/2011/D condition 5.5. EPD on 10 February 2021 wrote to the EP Holder that they considered the Operation Phase EM&A Report was generally in order and met the EP Condition 5.5.
- 11.1.7 Pursuant to EM&A Manual Section 10.2, the implementation of landscape mitigation measures during establishment period shall be audited by a qualified landscape architect. Site inspection for establishment period was commenced in August 2019 and competed in July 2020 respectively. The relevant checklists were included in the corresponding EM&A Reports. Besides, further to the Landscape Plan (Rev.4) approved by EPD via letter dated 7 June 2021, minor changes on site layout was required, AECOM then submitted the Landscape Plan Rev.5 to EPD on 31 May 2022 for approval.

# 11.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH

11.2.1 The construction works under Contract 2, 3, 4, 5 7 and SS C505 was substantially completed. Construction activities for other Contract 6 was substantially completed, the remaining site activities included maintenance works and construction works near Kong Yiu channel.

#### 11.3 KEY ISSUES FOR THE COMING MONTH

11.3.1 Since the construction works under the Project were substantial completed, the potential environmental impacts associated with Project are considered negligible. However, the

# Agreement No. CE 45/2008 (CE) Liantang/Heung Yuen Wai Boundary Control Point and Associated Works Monthly Environmental Monitoring & Audit Report (No.108) – July 2022



Contractor was reminded that the environmental mitigation measures shall be properly implemented and maintained where applicable, as per the Mitigation Implementation Schedule, in the remaining construction period and operational phase.

- 11.3.2 The Heung Yuen Wai (HYW) Highway and connecting roads under the Project was opened on 26 May 2019 and the BCP was partially opened on 26 August 2020. All relevant requirements as stipulated in the EP and the approved EIA report (including the EM&A Manual) for the commencement of operation of the Project shall be strictly complied with.
- 11.3.3 As advised by AECOM, additional works involving the construction of flood walls and maintenance ramp around Kong Yiu Drainage Channel to the south of Heung Yuen Wai BCP are proposed. It is considered that VEP is not required for the aforementioned additional works.



## 12 CONCLUSIONS AND RECOMMENDATIONS

## 12.1 CONCLUSIONS

- 12.1.1 This is the **108**<sup>th</sup> monthly EM&A report presenting the monitoring results and inspection findings for the Reporting Period from **1** to **31 July 2022**.
- 12.1.2 For air quality monitoring, no 1-hour TSP and 24-hour TSP monitoring results triggered the Action /Limit Level was recorded in the Reporting Period.
- 12.1.3 In the Reporting Period, no construction noise measurement results that exceeded the Limit Level were recorded. Moreover, no valid noise complaint (which triggered an Action Level) exceedance was recorded.
- 12.1.4 In the Reporting Period, no exceedance was recorded for water quality monitoring.
- During the Reporting Period, joint site inspection has been carried out by the ET and the Contractor on 7, 14, 21 and 28 July 2022. Joint site inspection with the RE, ET, IEC and the contractor was carried out on 28 July 2022. No non-compliance observed during the site inspection.
- 12.1.6 In this Reporting Period, no environmental complaint was received. Moreover, no summons and prosecution under the EM&A Programme was lodged in the Reporting Period.


## 12.2 RECOMMENDATIONS

12.2.1 Since the construction works under the Project were substantial completed, the potential environmental impacts associated with Project are considered negligible. However, the Contractor was reminded that the environmental mitigation measures shall be properly implemented and maintained where applicable, as per the Mitigation Implementation Schedule, in the remaining construction period and operational phase.



# Appendix A

Layout plan of the Project

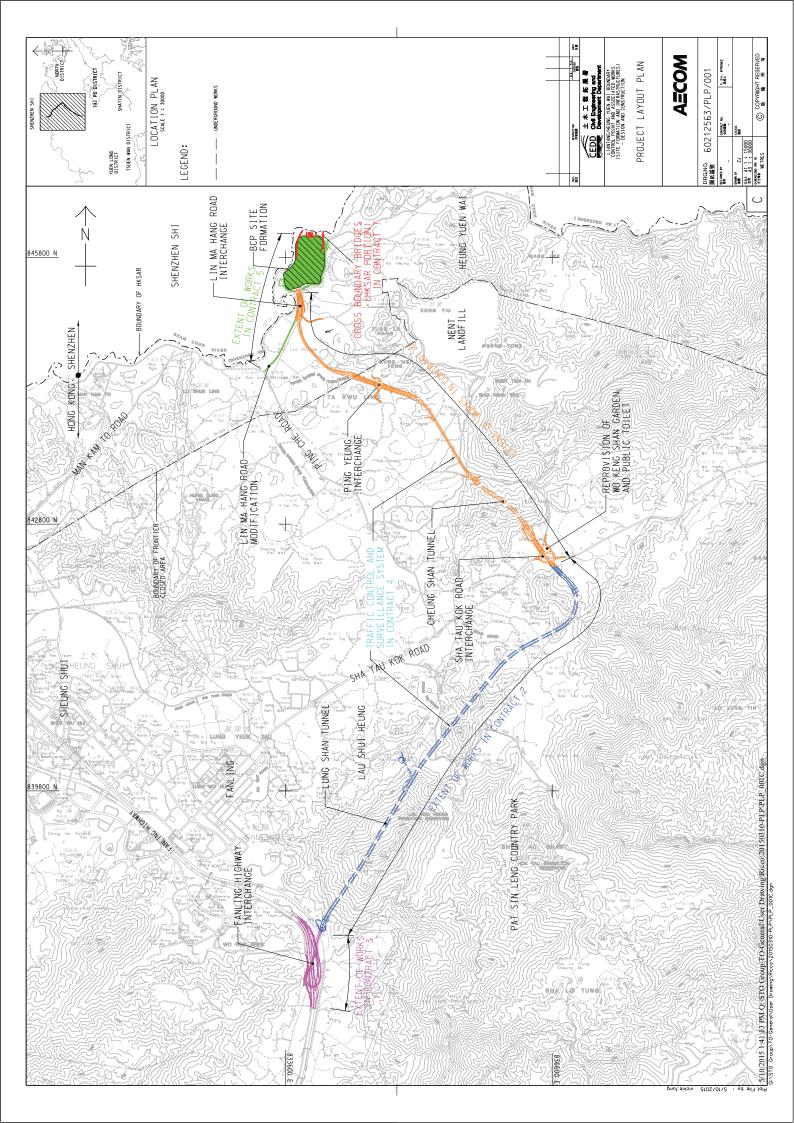




# Appendix B

**Organization Chart** 



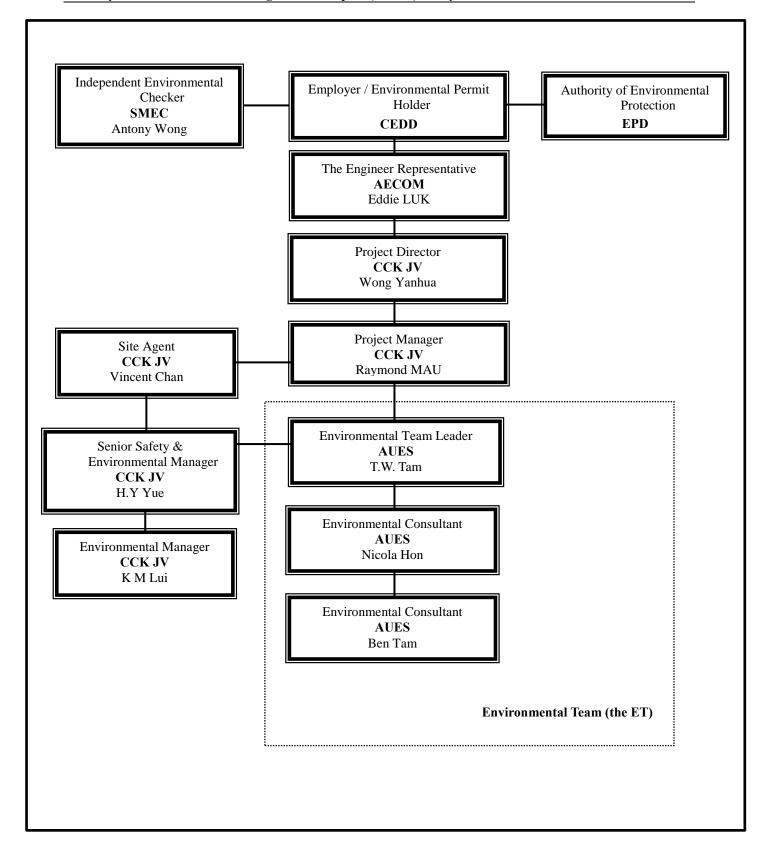

Environmental Management Organization - CV/2013/08



## Contact Details of Key Personnel for Contract 6 - CV/2013/08

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
AECOM	Engineer's Representative	Eddie LUK	2251 0682	2251 0698
SMEC	Independent Environmental Checker	Antony Wong	3995 8120	3995 8101
CCK JV	Project Director	Wang Yanhua	6190 4212	
CCK JV	Project Manager	Raymond Mau Sai-Wai	9011 5340	
CCK JV	Site Agent	Vincent Chan	9655 9404	
CCK JV	Senior Safety & Environmental Manager	H.Y. Yue	9185 8186	
CCK JV	Environmental Manager	K M Lui	5113 8223	
AUES	Environmental Team Leader	TW Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Ben Tam	2959 6059	2959 6079
AUES	Environmental Consultant	Nicola Hon	2959 6059	2959 6079

## Legend:

CEDD (Employer) – Civil Engineering and Development Department

AECOM (Engineer) – AECOM Asia Co. Ltd.

CCK JV (Main Contractor) – CRBE-CEC-Kaden Joint Venture

SMEC (IEC) – SMEC Asia Limited

AUES (ET) – Action-United Environmental Services & Consulting



# **Appendix C**

**3-month rolling Construction Program** 

# Liantang / Heung Yuen Wai Boundary Control Point and Associated Works

CEDD Contract No: CV/2013/08

**Main Contractor: CRBE-CEC-Kaden Joint Venture** 




## Tentative Three Months (Jul, Aug&Sep 2022) Construction Rolling Progam


Construction Activites
Maintenance works
Construction works near Kong Yiu Channel




# Appendix D

Designated Monitoring Locations as Recommended in the Approved EM&A Manual

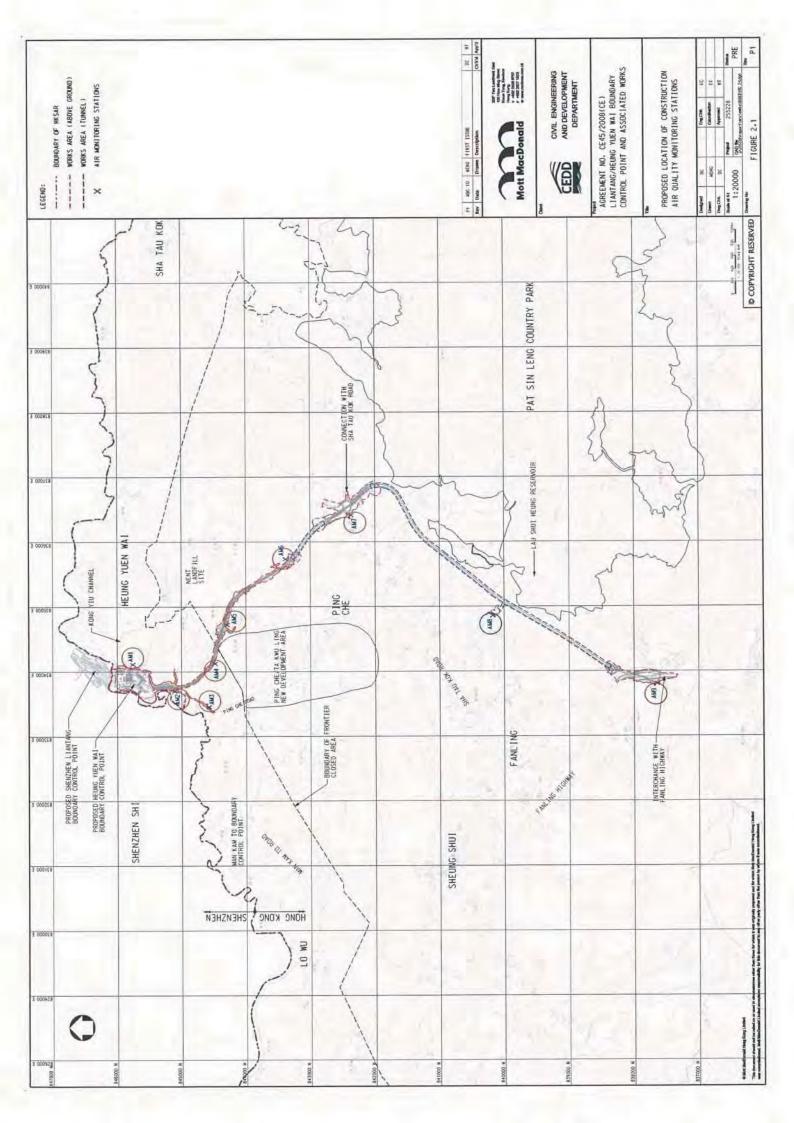

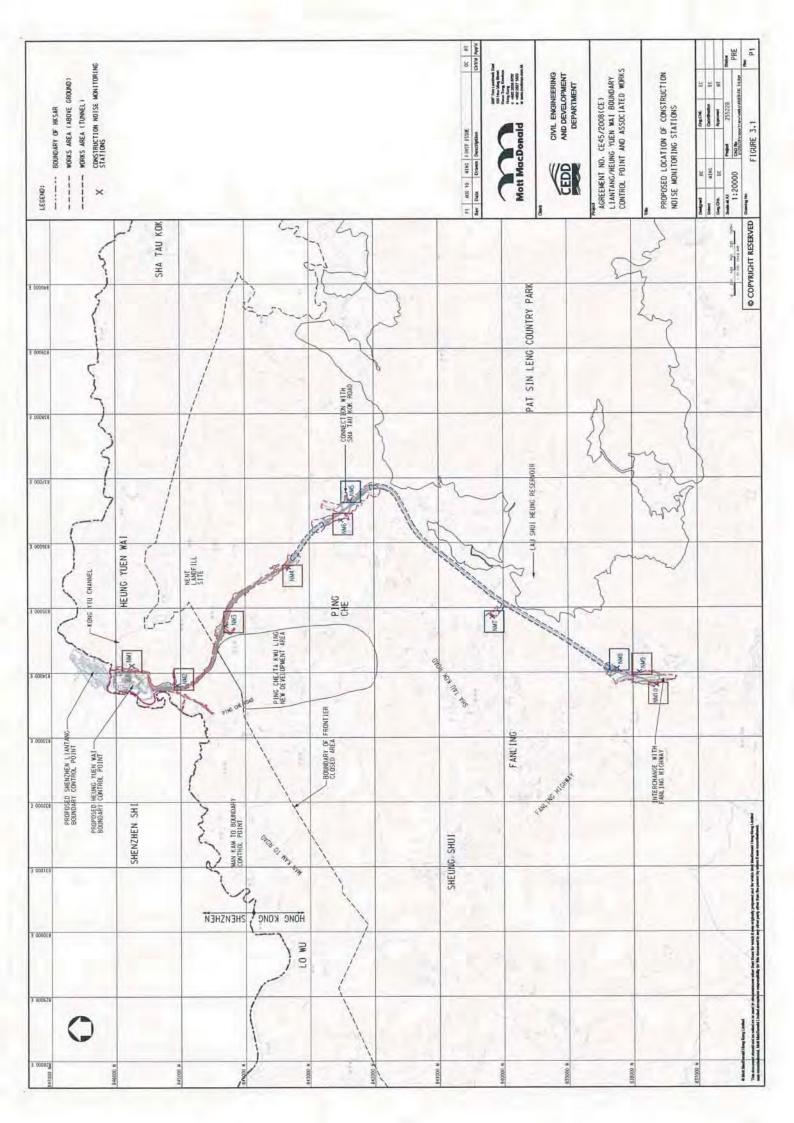


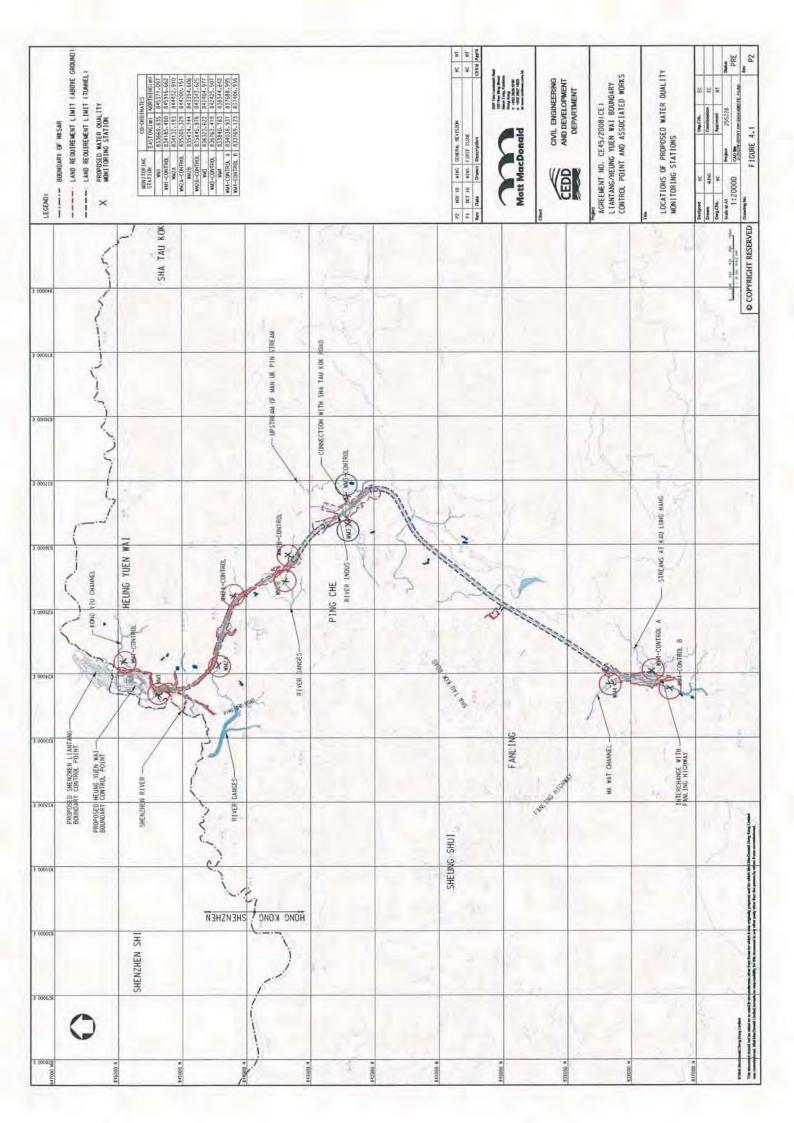





# **Appendix E**

**Monitoring Locations for Impact Monitoring** 

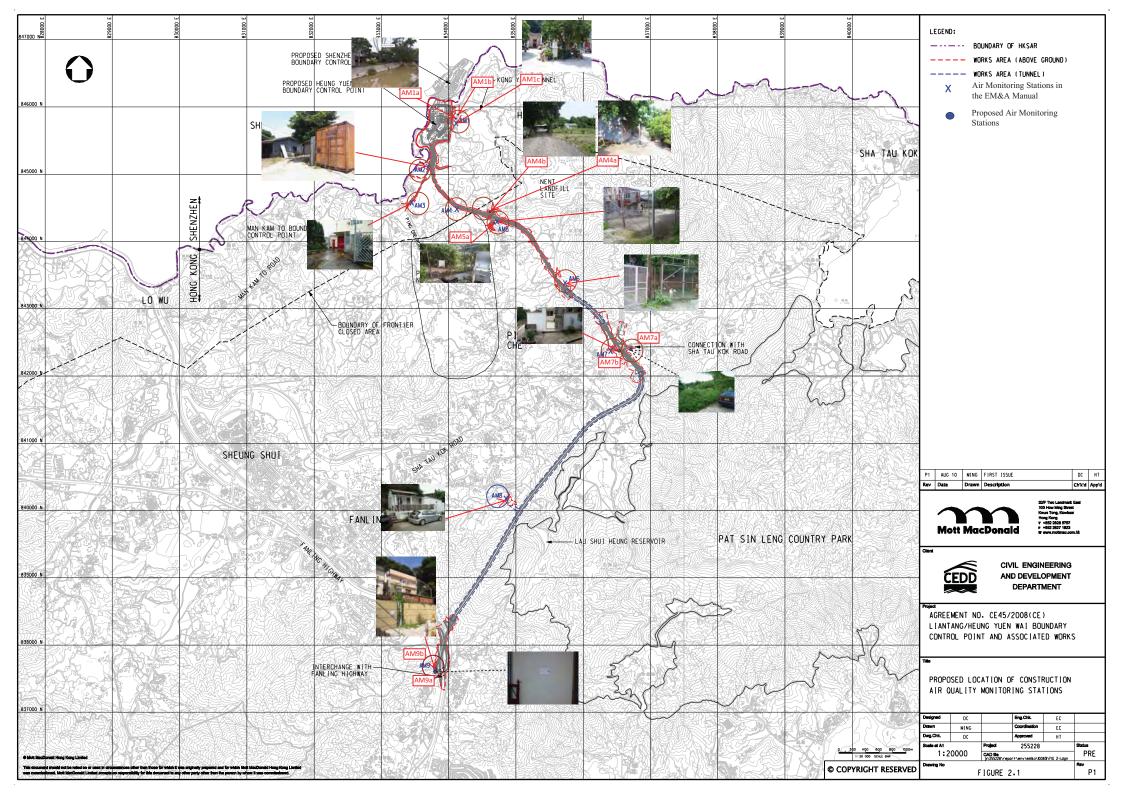

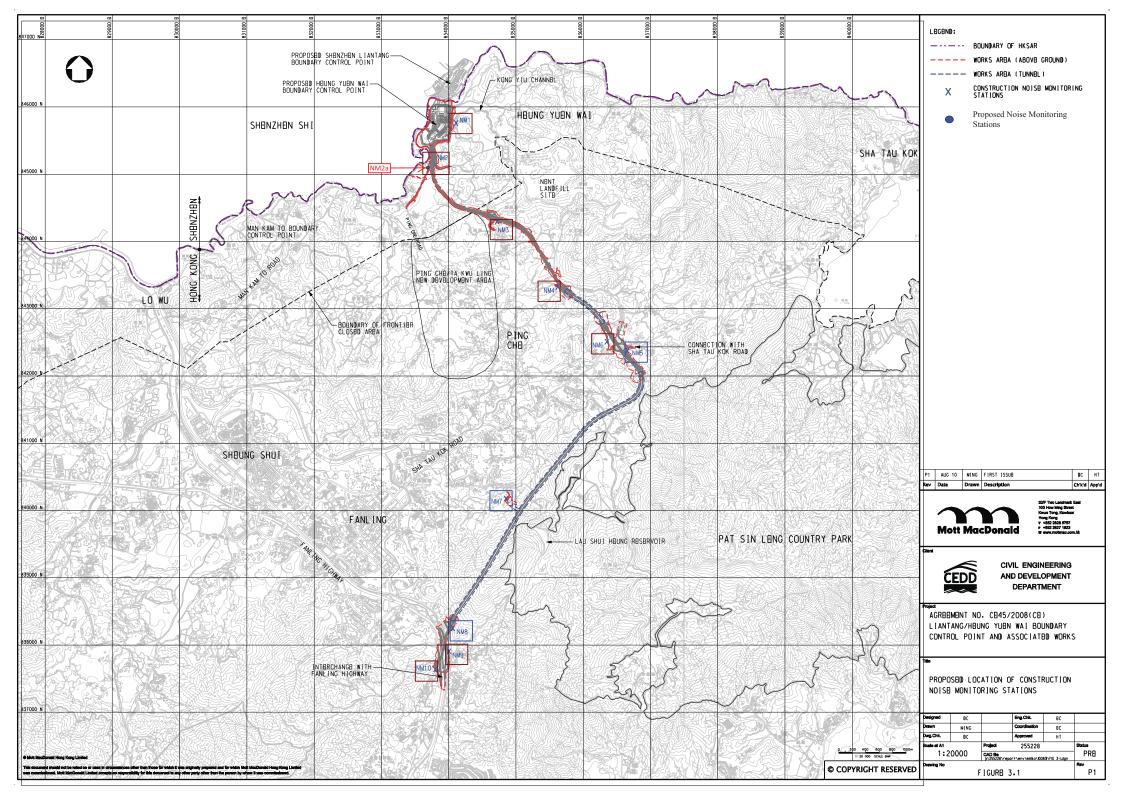

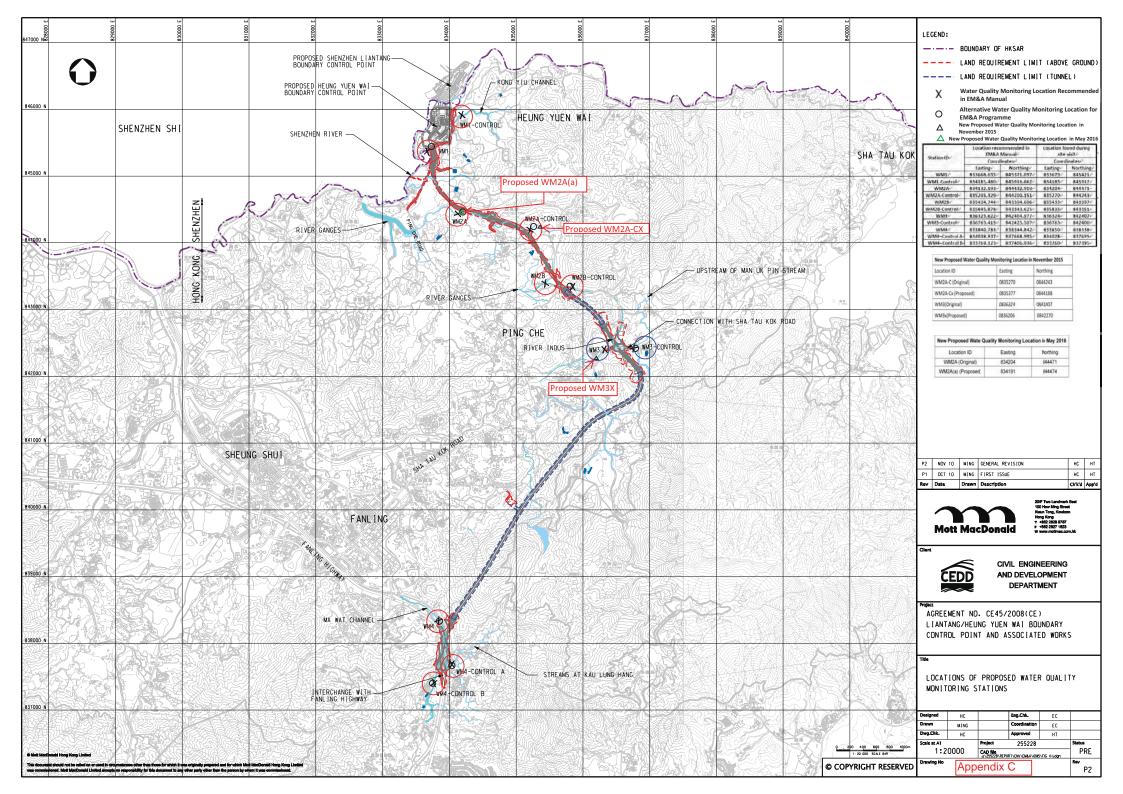



# **Appendix F**

Calibration Certificate of Monitoring Equipment and HOKLAS-accreditation Certificate of the Testing Laboratory

Location: Village House near Lin Ma Hang Road Date of Calibration: 1/6/2022 Next Calibration Date: Location ID: AM2 1/8/2022 Technician:

CONDITIONS

Sea Level Pressure (hPa) 1007.1 Corrected Pressure (mm Hg) Temperature (°C) Temperature (K)

**CALIBRATION ORIFICE** 

Make-> TISCH Model-> 5025A Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

.99838 0.00903 Eric

## **CALIBRATION**

	1	1		1		1	
Plate	H20(L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6	6	12.0	1.722	56	55.48	Slope = 30.2657
13	4.1	4.1	8.2	1.424	48	47.56	Intercept = 3.6015
10	3.5	3.5	7.0	1.316	43	42.60	Corr. coeff. = 0.9982
7	2.2	2.2	4.4	1.045	36	35.67	
5	1.2	1.2	2.4	0.773	27	26.75	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Ostd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

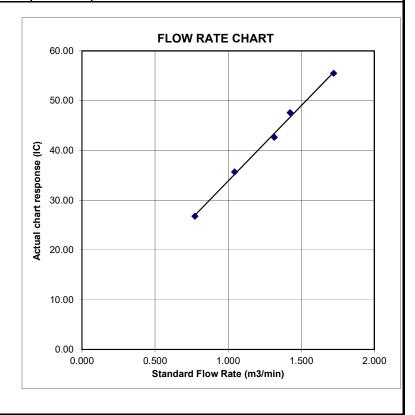

Location: Ta Kwu Ling Fire Service Station

Date of Calibration: 1/6/2022

Location ID: AM3

Next Calibration Date: 1/8/2022

Technician: Eric

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.1 28.7 Corrected Pressure (mm Hg)
Temperature (K)

/55.325 302

**CALIBRATION ORIFICE** 

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

1.99838

#### CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.3	6.3	12.6	1.764	56	55.48	Slope = 35.8826
13	4.8	4.8	9.6	1.541	48	47.56	Intercept = $-8.6557$
10	3.9	3.9	7.8	1.389	40	39.63	Corr. coeff. = 0.9928
7	2.9	2.9	5.8	1.199	33	32.70	
5	1.5	1.5	3.0	0.863	24	23.78	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

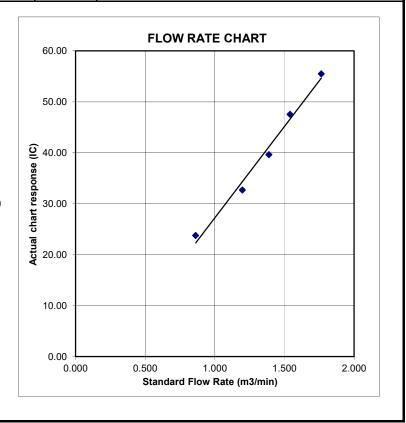

Location: Nga Yiu Ha VillageDate of Calibration:1/6/2022Location ID: AM4bNext Calibration Date:1/8/2022

Technician:

**CONDITIONS** 

Sea Level Pressure (hPa) 1007.1 Corrected Pressure (mm Hg) 755.32 Temperature (°C) 28.7 Temperature (K) 30

**CALIBRATION ORIFICE** 

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

1.99838 -0.00903 Eric

#### CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.5	6.5	13.0	1.792	56	55.48	Slope = $27.3778$
13	5.1	5.1	10.2	1.588	51	50.53	Intercept = $6.9407$
10	3.4	3.4	6.8	1.297	44	43.59	Corr. coeff. = 0.9980
7	2.3	2.3	4.6	1.068	36	35.67	
5	1.3	1.3	2.6	0.804	29	28.73	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

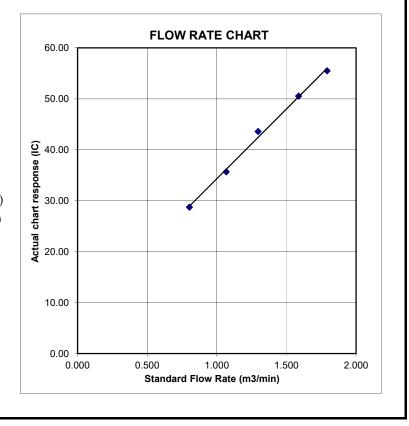

Location : Ping Yeung Village HouseDate of Calibration:1/6/2022Location ID : AM5aNext Calibration Date:1/8/2022

Technician: Eric

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.1 28.7

Corrected Pressure (mm Hg)
Temperature (K)

755.325 302

**CALIBRATION ORIFICE** 

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

1.99838 -0.00903

#### CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.3	6.3	12.6	1.764	53	52.51	Slope = $29.8213$
13	4.4	4.4	8.8	1.475	46	45.58	Intercept = $0.3462$
10	3.4	3.4	6.8	1.297	39	38.64	Corr. coeff. = 0.9975
7	2.2	2.2	4.4	1.045	31	30.71	
5	1.2	1.2	2.4	0.773	24	23.78	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

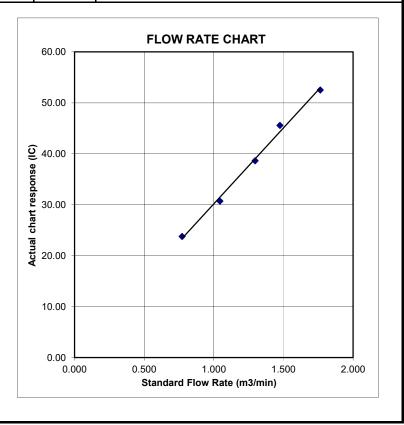

Location: Wo Keng Shan Village HouseDate of Calibration:1/6/2022Location ID: AM6Next Calibration Date:1/8/2022

Technician:

Eric

CONDITIONS

Sea Level Pressure (hPa) 1007.1 Corrected Pressure (mm Hg) 755.325 Temperature (°C) 28.7 Temperature (K) 302

**CALIBRATION ORIFICE** 

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept ->

1.99838 -0.00903

#### CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6	6	12.0	1.722	55	54.49	Slope = $30.8738$
13	4.8	4.8	9.6	1.541	48	47.56	Intercept = 0.9554
10	3.3	3.3	6.6	1.278	42	41.61	Corr. coeff. = 0.9969
7	2.5	2.5	5.0	1.113	35	34.68	
5	1.4	1.4	2.8	0.834	27	26.75	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

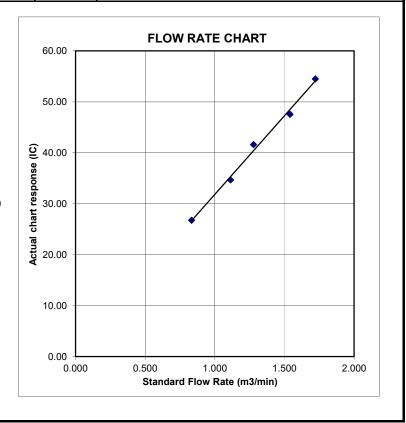

Location: Village House of Loi Tung Village

Date of Calibration: 1/6/2022

Location ID: AM7b

Next Calibration Date: 1/8/2022

CONDITIONS

Sea Level Pressure (hPa)
Temperature (°C)

1007.1 28.7

Corrected Pressure (mm Hg)
Temperature (K)

Technician:

755.325 302

Eric

**CALIBRATION ORIFICE** 

Make-> TISCH
Model-> 5025A
Serial # -> 1612

Qstd Slope -> Qstd Intercept -> 1.99838

## CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.4	6.4	12.8	1.778	58	57.47	Slope = $33.6930$
13	4.8	4.8	9.6	1.541	51	50.53	Intercept = -1.4993
10	3.7	3.7	7.4	1.353	46	45.58	Corr. coeff. = 0.9970
7	2.3	2.3	4.6	1.068	35	34.68	
5	1.4	1.4	2.8	0.834	26	25.76	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

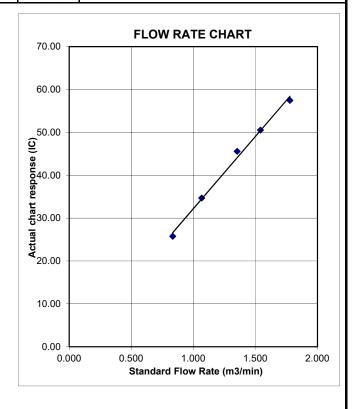



## RECALIBRATION DUE DATE:

December 27, 2022

# libration

**Calibration Certification Information** 

Cal. Date: December 27, 2021 Rootsmeter S/N: 438320

Ta: 295

°K

Operator: Jim Tisch Pa: 740.4

mm Hg

Calibration Model #: TE-5025A

Calibrator S/N: 1612

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3890	3.2	2.00
2	3	4	1	0.9760	6.4	4.00
3	5	6	1	0.8740	7.9	5.00
4	7	8	1	0.8320	8.8	5.50
5	9	10	1	0.6870	12.7	8.00

		Data Tabulat	ion		
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left( \text{Ta/Pa} \right)}$ (y-axis)
0.9799	0.7055	1.4029	0.9957	0.7168	0.8927
0.9756	0.9996	1.9841	0.9914	1.0157	1.2624
0.9736	1.1140	2.2183	0.9893	1.1320	1.4114
0.9724	1.1688	2.3265	0.9881	1.1876	1.4803
0.9673	1.4079	2.8059	0.9828	1.4306	1.7853
TO THE	m=	1.99838		m=	1.25135
QSTD	b=	-0.00903	QA	b=	-0.00574
27000	r=	0.99999		r=	0.99999

Calculation	ons
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va= ΔVol((Pa-ΔP)/Pa)
Qstd= Vstd/ΔTime	Qa= Va/ΔTime
For subsequent flow r	ate calculations:
Qstd= $1/m\left(\left(\frac{Pa}{\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}}\right)-b\right)$	Qa= $1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-t\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

## RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com

TOLL FREE: (877)263-7610

FAX: (513)467-9009




## CERTIFICATE OF CALIBRATION AND TESTING

TSI Incorporated, 500 Cardigan Road, Shoreview, MN 55126 USA Tel: 1-800-874-2811 1-651-490-2811 Fax: 1-651-490-3824 http://www.tsi.com

Environment Conditions		
Temperature	76.23 (24.6)	°F (°C)
Relative Humidity	19.5	%RH
Barometric Pressure	29.30 (992.2)	inHg (hPa)

Model	AM510
Serial Number	11008060

⊠ As Left	☑ In Tolerance	0.0000000000000000000000000000000000000
☐ As Found	Out of Tolerance	

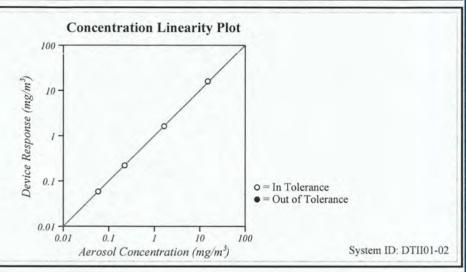

Co	NCENTRATIO	N					Unit: mg/m3
#	STANDARD	MEASURED	ALLOWABLE RANGE	#	STANDARD	MEASURED	ALLOWABLE RANGE
1	1.631	1.529	1.468~1.794	3	0.058	0.055	0.041~0.075
2	0.221	0.207	0.188~0.254	4	14.840	14.955	13.356~16.324

TSI Incorporated does hereby certify that all materials, components, and workmanship used in the manufacture of this equipment are in strict accordance with the applicable specifications agreed upon by TSI and the customer and with all published specifications. All performance and acceptance tests required under this contract were successfully conducted according to required specifications. There is no NIST standard for optical mass measurements. Calibration of this instrument performed by TSI has been done using emery oil and has been nominally adjusted to respirable mass per standard ISO 12103-1, Al test dust (Arizona dust). Our calibration ratio is greater than 4:1

Measurement Variable	System ID	Last Cal.	Cal. Due	Measurement Variable	System ID	Last Cal.	Cal. Due
DC Voltage	E003314	01-11-22	01-31-23	Photometer	E003319	08-30-21	02-28-22
Microbalance	M001324	01-29-21	01-31-23	Pressure	E003511	10-26-21	10-31-22
Flowmeter	E005626	03-09-21	03-31-22	DC Voltage	E003315	01-11-22	01-31-23

Calibrated

February 4, 2022

Date




## CERTIFICATE OF CALIBRATION AND TESTING

TSI Incorporated, 500 Cardigan Road, Shoreview, MN 55126 USA Tel: 1-800-874-2811 1-651-490-2811 Fax: 1-651-490-3824 http://www.tsi.com

<b>Environment Conditions</b>		
Temperature	76.22 (24.6)	°F (°C)
Relative Humidity	21.7	%RH
Barometric Pressure	29.32 (992.9)	inHg (hPa)

Model	AM510
Serial Number	11008017



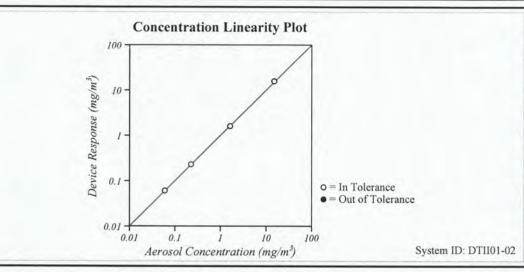

Co	NCENTRATIO	N					Unit: mg/m3
#	STANDARD	MEASURED	ALLOWABLE RANGE	#	STANDARD	MEASURED	ALLOWABLE RANGE
1	1.609	1.505	1.448~1.770	3	0.059	0.057	0.041~0.077
2	0.223	0.216	0.190~0.256	4	14.848	14.816	13.363~16.333

TSI Incorporated does hereby certify that all materials, components, and workmanship used in the manufacture of this equipment are in strict accordance with the applicable specifications agreed upon by TSI and the customer and with all published specifications. All performance and acceptance tests required under this contract were successfully conducted according to required specifications. There is no NIST standard for optical mass measurements. Calibration of this instrument performed by TSI has been done using emery oil and has been nominally adjusted to respirable mass per standard ISO 12103-1, Al test dust (Arizona dust). Our calibration ratio is greater than 4:1

Measurement Variable	System ID	Last Cal.	Cal. Due	Measurement Variable	System ID	Last Cal.	Cal. Due
DC Voltage	E003314		01-31-23		E003319	The second secon	02-28-22
Microbalance	M001324	01-29-21	01-31-23	Pressure	E003511	10-26-21	10-31-22
Flowmeter	E005626	03-09-21	03-31-22	DC Voltage	E003315	01-11-22	01-31-23

Calibrated Calibrated

February 4, 2022

Date

## ALS Technichem (HK) Pty Ltd

## ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



## SUB-CONTRACTING REPORT

HK2210522 WORK ORDER CONTACT : MR BEN TAM

**CLIENT** : ACTION-UNITED ENVIRONMENTAL

**SERVICES & CONSULTING** 

: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 **ADDRESS** SUB-BATCH

> DATE RECEIVED : 18-MAR-2022 TAI LIN PAI ROAD, KWAI CHUNG, N.T. DATE OF ISSUE : 28-MAR-2022

**PROJECT** NO. OF SAMPLES : 1

CLIENT ORDER

## General Comments

Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition. The result(s) related only to the

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Richard Fund Managing Director

This is the Final Report and supersedes any preliminary report with this batch number.

All pages of this report have been checked and approved for release.

: HK2210522 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID		Sample Date	External Lab Report No.
ID		Туре		
HK2210522-001	S/N: 2X6145	AIR	18-Mar-2022	S/N: 2X6145

## **Equipment Verification Report (TSP)**

## **Equipment Calibrated:**

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 2X6145

Equipment Ref: EQ105

## **Standard Equipment:**

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018 & HVS 019

Last Calibration Date: 5 November 2021 & 13 December 2021

**Equipment Verification Results:** 

Verification Date: 20 December 2021 & 7 January 2022

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
7 Jan 22	2hr	11:55 ~ 13:55	18.6	1021.6	55.1	2445	20.4
7 Jan 22	2hr27mins	14:23 ~ 16:50	18.6	1021.6	54.8	2316	15.8
7 Jan 22	2hr09mins	16:50 ~ 18:59	18.6	1021.6	56.5	2504	19.4
20 Dec 21*	45mins	10:15 ~ 11:00	20.5	1008.7	472.0	9410	209.1
20 Dec 21*	31mins	11:05 ~ 11:36	20.5	1008.7	187.2	3955	129.2

<sup>(\*)</sup> Suspended particle was added into calibration room of HVS019 for high concentration test.

Sensitivity Adjustment Scale Setting (Before Calibration)

Sensitivity Adjustment Scale Setting (After Calibration)


\_\_\_\_\_<u>586 (CPM)</u> \_\_\_\_\_<u>586 (CPM)</u>

## Linear Regression of Y or X

Slope (K-factor):  $2.0155 (\mu g/m^3)/CPM$ 

Correlation Coefficient (R) 0.9709

Date of Issue 15 January 2022

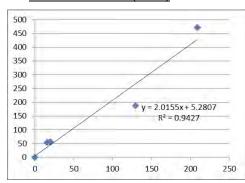

## Remarks:

1. Strong Correlation (R>0.8)

2. Factor 2.0155 (µg/m³)/CPM should be apply for TSP monitoring

\*If R<0.5, repair or re-verification is required for the equipment

Operator: \_\_\_\_\_\_ Fai So\_\_\_\_ Signature: \_\_\_\_\_\_ Date: \_\_\_\_\_15 January 2022

QC Reviewer : Ben Tam Signature : Date : 15 January 2022

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 5-Nov-21
Location ID: Calibration Room Next Calibration Date: 5-Feb-22

## **CONDITIONS**

Sea Level Pressure (hPa) Temperature (°C) 1012.5 25.6

Corrected Pressure (mm Hg)
Temperature (K)

759.375 299

## **CALIBRATION ORIFICE**

ISCH
025A
Jan-21

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10574 -0.00985 18-Jan-22

## **CALIBRATION**

L								
	Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
L	No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
	18	6.2	6.2	12.4	1.675	52	51.93	Slope = 24.2092
	13	5	5	10.0	1.504	48	47.93	Intercept = 10.8881
	10	3.9	3.9	7.8	1.329	42	41.94	Corr. coeff. = 0.9959
	8	2.5	2.5	5.0	1.065	36	35.95	
	5	1.0	1.0	2.0	0.675	28	27.96	

## Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tay = daily average temperature

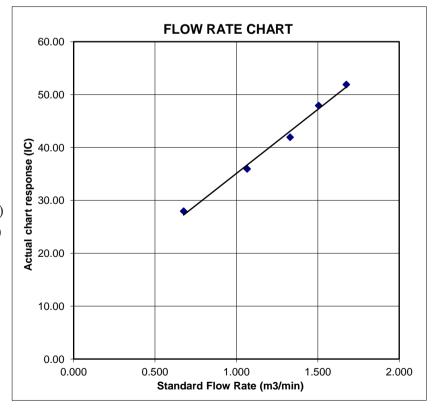

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 13-Dec-21

Location: Date of Calibration Page New Calibration Page 13 May 22

Location ID: Calibration Room Next Calibration Date: 13-Mar-22

## CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1014.3 24.0 Corrected Pressure (mm Hg)
Temperature (K)

760.725

## **CALIBRATION ORIFICE**

Make-> TISCH
Model-> 5025A
Calibration Date-> 19-Jan-21

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.10574 -0.00985 18-Jan-22

## **CALIBRATION**

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.2	6.2	12.4	1.681	52	52.11	Slope = 36.4525
13	4.9	4.9	9.8	1.495	44	44.10	Intercept = -9.0200
10	3.7	3.7	7.4	1.299	40	40.09	Corr. coeff. = 0.9943
8	2.4	2.4	4.8	1.047	30	30.06	
5	1.5	1.5	3.0	0.829	20	20.04	

#### Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration ( deg K )

Pstd = actual pressure during calibration ( mm Hg )

## For subsequent calculation of sampler flow:


1/m(( I )[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

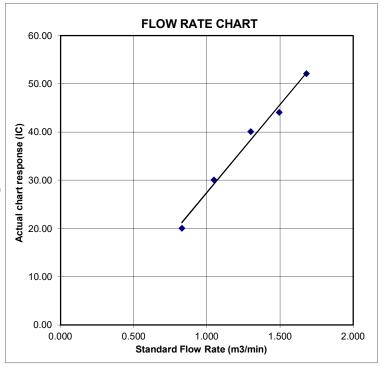



RECALIBRATION DUE DATE:

January 19, 2022

# Certificate of Calibration

**Calibration Certification Information** 

Cal. Date: January 19, 2021

Rootsmeter S/N: 438320

Ta: 294 Pa: 755.1 °K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1941

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4830	3.2	2.00
2	3	4	1	1.0420	6.4	4.00
3	5	6	1	0.9290	8.0	5.00
4	7	8	1	0.8840	8.8	5.50
5	9	10	1	0.7340	12.9	8.00

	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$						
Vstd	Qstd	$\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}$		Qa	$\sqrt{\Delta H (Ta/Pa)}$		
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)		
1.0029	0.6762	1.4192	0.9958	0.6715	0.8824		
0.9986	0.9583	2.0071	0.9915	0.9516	1.2479		
0.9965	1.0726	2.2440	0.9894	1.0650	1.3952		
0.9954	1.1260	2.3535	0.9883	1.1180	1.4633		
0.9899	1.3487	2.8385	0.9829	1.3391	1.7648		
10.00	m=	2.10574		m=	1.31858		
QSTD	b=	-0.00985	QA	b=	-0.00612		
	r=	0.99992		r=	0.99992		

	Calculation	ns		
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)	
Qstd=	Vstd/ΔTime	Qa= Va/ΔTime		
	For subsequent flow ra	te calculatio	ns:	
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$	

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

## RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30

FAX: (513)467-9009



# 輝創工程有限公司

## Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C221362

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC22-0258)

Date of Receipt / 收件日期: 14 February 2022

Description / 儀器名稱

Sound Calibrator (EQ089)

Manufacturer / 製造商

Rion NC-75

Model No. / 型號 Serial No. / 編號

34680623

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 :  $(23 \pm 2)^{\circ}C$ 

Relative Humidity / 相對濕度:  $(50 \pm 25)\%$ 

Line Voltage / 電壓

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 12 March 2022

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Fluke Everett Service Center, USA

- Agilent Technologies / Keysight Technologies

Tested By 測試

K C Lee Engineer

Certified By 核證

H C Chan

Date of Issue 簽發日期

16 March 2022

Page 1 of 2

Engineer

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書壽先獲本實驗所書而批准。



# Certificate of Calibration 校正證書

Certificate No.:

C221362

證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours before the commencement of the test.

2. The results presented are the mean of 3 measurements at each calibration point.

3. Test equipment:

> Equipment ID CL130 CL281 TST150A

Description Universal Counter Multifunction Acoustic Calibrator Measuring Amplifier

Certificate No. C213954 AV210017 C201309

4. Test procedure: MA100N.

5. Results:

5.1 Sound Level Accuracy

UUT	Measured Value	Mfr's Spec.	Uncertainty of Measured Value
Nominal Value	(dB)		(dB)
94 dB, 1 kHz	94.0	± 0.25	± 0.2

Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's	Uncertainty of Measured Value (Hz)
(kHz)	(kHz)	Spec.	
1	1.000 0	1 kHz ± 0.1 %	± 0.1

Remark: The uncertainties are for a confidence probability of not less than 95 %.

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本意書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



## 輝創工程有限公司

## Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C216479

證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號: IC21-2189)

Date of Receipt / 收件日期: 25 October 2021

Description / 儀器名稱

Sound Level Meter (EQ016)

Manufacturer / 製造商

Rion NL-52

Model No. / 型號 Serial No. / 編號

00464681

Supplied By / 委託者

Action-United Environmental Services and Consulting

Unit A, 20/F., Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 温度 : (23 ± 2)°C

Relative Humidity / 相對濕度 :

 $(50 \pm 25)\%$ 

Line Voltage / 電壓 :

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期

9 November 2021

TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.

The results do not exceed manufacturer's specification.

The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory
- Agilent Technologies / Keysight Technologies

- Fluke Everett Service Center, USA

Tested By

測試

K P Cheuk Project Engineer

Certified By

核證

K C/Lee Engineer Date of Issue 簽發日期

10 November 2021

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in tall, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本設計需先獲本實驗所書而批准。



## 輝創工程有限公司

## Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C

C216479

證書編號

 The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 12 hours, and switched on to warm up for over 10 minutes before the commencement of the test.

- 2. Self-calibration was performed before the test.
- 3. The results presented are the mean of 3 measurements at each calibration point.
- 4. Test equipment:

Equipment ID CL280

Description

Certificate No.

CL280 CL281 40 MHz Arbitrary Waveform Generator

C210084

Multifunction Acoustic Calibrator

AV210017

- 5. Test procedure: MA101N.
- 6. Results:
- 6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

	UUT	Setting		Applie	d Value	UUT	IEC 61672 Class 1 Spec. (dB)
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	
30 - 130	$L_A$	A	Fast	94.00	1	93.6	± 1.1

6.1.2 Linearity

	UU	T Setting	Applie	UUT			
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	
30 - 130	L <sub>A</sub>	A	Fast	Fast 94.00 1	1	93.6 (Ref.)	
				104.00		103.6	
				114.00		113.6	

IEC 61672 Class 1 Spec. :  $\pm$  0.6 dB per 10 dB step and  $\pm$  1.1 dB for overall different.

6.2 Time Weighting

UUT Setting				Applie	d Value	UUT	IEC 61672
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L <sub>A</sub>	L <sub>A</sub> A	Fast	94.00	1	93.6	Ref.
	1 12-1	1	Slow			93.6	± 0.3

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

Sun Creation Engineering Limited – Calibration & Testing Laboratory
c/o 4/F, I Hing On Lane, Tuen Mun, New Territories, Hong Kong

鄭創工程有限公司 – 校正及檢測實驗所
c/o 香港新界屯門與安里一號四樓
Tel/電話: (852) 2927 2606 Fax/傳真: (852) 2744 8986 E-mail/電郵: callab@suncreation.com

Page 2 of 4



# 輝創工程有限公司

#### Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C216479

證書編號

6.3 Frequency Weighting

A-Weighting 6.3.1

UUT Setting			Applied Value		UUT	IEC 61672	
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	LA	A	Fast	94.00	63 Hz	67.3	$-26.2 \pm 1.5$
				125 Hz 250 Hz	125 Hz	77.4	$-16.1 \pm 1.5$
					250 Hz	84.9	$-8.6 \pm 1.4$
					500 Hz	90.4	$-3.2 \pm 1.4$
					1 kHz	93.6	Ref.
				2 kHz	94.8	$+1.2 \pm 1.6$	
				4 kHz	94.6	$+1.0 \pm 1.6$	
					8 kHz	92.6	-1.1 (+2.1; -3.1)
					16 kHz	85.7	-6.6 (+3.5; -17.0)

C-Weighting 6.3.2

UUT Setting		Applied Value		UUT	IEC 61672		
Range (dB)	Function	Frequency Weighting	Time Weighting	Level (dB)	Freq.	Reading (dB)	Class 1 Spec. (dB)
30 - 130	L <sub>C</sub>	C	Fast	94.00	63 Hz	92.7	$-0.8 \pm 1.5$
					125 Hz	93.4	$-0.2 \pm 1.5$
					250 Hz	93.6	$0.0 \pm 1.4$
					500 Hz	93.6	$0.0 \pm 1.4$
					1 kHz	93.6	Ref.
				2 kHz	93.5	$-0.2 \pm 1.6$	
					4 kHz	92.8	$-0.8 \pm 1.6$
					8 kHz	90.7	-3.0 (+2.1; -3.1)
					16 kHz	83.7	-8.5 (+3.5; -17.0)

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



# 輝創工程有限公司

#### Sun Creation Engineering Limited

Calibration & Testing Laboratory

# Certificate of Calibration 校正證書

Certificate No.: C216479

證書編號

Remarks: - UUT Microphone Model No.: UC-59 & S/N: 17434

- Mfr's Spec. : IEC 61672 Class 1

- Uncertainties of Applied Value: 94 dB : 63 Hz - 125 Hz : ± 0.35 dB

250 Hz - 500 Hz : ± 0.30 dB 1 kHz  $: \pm 0.20 \text{ dB}$ 2 kHz - 4 kHz  $: \pm 0.35 \text{ dB}$ 8 kHz  $: \pm 0.45 \text{ dB}$ 16 kHz : ± 0.70 dB

104 dB: 1 kHz  $:\pm 0.10 \text{ dB (Ref. 94 dB)}$ 114 dB: 1 kHz : ± 0.10 dB (Ref. 94 dB)

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Sun Creation Engineering Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory

本證書所載校正用之測試器材均可測源至國際標準+局部複印本證書需先獲本實驗所書面批准。

<sup>-</sup> The uncertainties are for a confidence probability of not less than 95 %.



#### ALS Technichem (HK) Pty Ltd

11/F, Chung Shun Knitting Centre 1-3 Wing Yip Street, Kwai Chung N.T., Hong Kong T: +852 2610 1044 | F: +852 2610 2021

# REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MF

MR BEN TAM

WORK ORDER:

HK2223600

CLIENT:

**ACTION-UNITED ENVIRONMENTAL SERVICES &** 

**CONSULTING** 

ADDRESS:

RM A 20/F., GOLD KING IND BLDG,

SUB-BATCH:

0

NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.

LABORATORY:

HONG KONG

DATE RECEIVED:

20-Jun-2022

DATE OF ISSUE:

27-Jun-2022

#### **SPECIFIC COMMENTS**

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client.

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

Equipment Type:

Multifunctional Meter

Service Nature:

Performance Check

Scope:

Conductivity, Dissolved Oxygen, pH Value, Turbidity, Salinity and Temperature

Brand Name/ Model No.:

[YSI]/ [Professional DSS]

Serial No./ Equipment No.:

[17B102764/17B100758]/ [EQW019]

Date of Calibration:

23-June-2022

#### **GENERAL COMMENTS**

This report superseded any previous report(s) with same work order number.

Ms. Lin Wai Yu, Iris

Assistant Manager - Inorganics

 $This\ report\ may\ not\ be\ reproduced\ except\ with\ prior\ written\ approval\ from\ ALS\ Technichem\ (HK)\ Pty\ Ltd.$ 

# REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

HK2223600 WORK ORDER:

SUB-BATCH:

DATE OF ISSUE: 27-Jun-2022

ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT:

**Equipment Type:** Multifunctional Meter

Brand Name/ Model No.:

[YSI]/ [Professional DSS]

Serial No./

[17B102764/17B100758]/ [EQW019]

Equipment No.: Date of Next Calibration:

Date of Calibration: 23-June-2022 23-September-2022

PARAMETERS:

Conductivity Method Ref: APHA (21st edition), 2510B

Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)
146.9	160.5	+9.3
6667	7197	+7.9
12890	14036	+8.9
58670	61677	+5.1
	Tolerance Limit (%)	±10.0

Dissolved Oxygen

Method Ref: APHA (21st edition), 45000: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
2.82	2.88	+0.06
5.03	5.13	+0.10
8.38	8.37	-0.01
	Tolerance Limit (mg/L)	±0.20

pH Value

Method Ref: APHA (21st edition), 4500H: B

Expected Reading (pH unit)	Displayed Reading (pH unit)	Tolerance (pH unit)
4.0	3.85	-0.15
7.0	7.10	+0.10
10.0	10.02	+0.02
	Tolerance Limit (pH unit)	±0.20

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Ms. Lin Wai Yu, Iris

Assistant Manager - Inorganics

# REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

WORK ORDER: HK2223600

SUB-BATCH:

DATE OF ISSUE: 27-Jun-2022

CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type: Multifunctional Meter

Brand Name/ Model No.:

[YSI]/ [Professional DSS]

Serial No./ Equipment No.:

[17B102764/17B100758]/ [EQW019]

Date of Calibration: 23-June-2022 Date of Next Calibration: 23-September-2022

PARAMETERS:

Turbidity Method Ref: APHA (21st edition), 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	-0.42	
4	4.31	+7.7
40	38.64	-3.4
80	76.24	-4.7
400	387.03	-3.2
800	737.96	-7.8
	Tolerance Limit (%)	±10.0

Salinity Method Ref: APHA (21st edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.00	
10	10.10	+1.0
20	20.54	+2.7
30	30.74	+2.5
	Tolerance Limit (%)	±10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Ms. Lin Wai Yu, Iris

Assistant Manager - Inorganics

# REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

WORK ORDER: HK2223600

SUB-BATCH: (

DATE OF ISSUE: 27-Jun-2022

CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type: Multifunctional Meter

Brand Name/ Model No.:

[YSI]/ [Professional DSS]

Serial No./ Equipment No.: [17B102764/17B100758]/ [EQW019]

Date of Calibration: 23-June-2022 Date of Next Calibration: 23-September-2022

PARAMETERS:

Temperature Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
12.0	12.8	+0.8
21.5	21.2	-0.3
38.0	37.0	-1.0
	Tolerance Limit (°C)	±2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless

of equipment precision or significant figures.

16:3

Ms. Lin Wai Yu, Iris

Assistant Manager - Inorganics



## **Hong Kong Accreditation Service** 香港認可處

# **Certificate of Accreditation**

認可證書

This is to certify that 特此證明

# ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行載於認可範圍內下述測試類別中的指定實驗所活動

# **Environmental Testing**

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 28 February 2020

簽發日期:二零二零年二月二十八日

Registration Number: HOKLAS 066

註冊號碼:



Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日



# Appendix G

**Event and Action Plan** 



# **Event and Action Plan for Air Quality**

Event	ET	IEC	ER	Action Contractor
Action Level				
Exceedance for one sample	I. Identify source, investigate the causes of exceedance and propose remedial measures;     Inform IEC and ER;     Repeat measurement to confirm finding;     Increase monitoring frequency to daily.	Check monitoring data submitted by ET;     Check Contractor's working method.		Rectify any unacceptable practice;     Amend working methods if appropriate.
2. Exceedance for two or more consecutive samples	1. Identify source; 2. Inform IEC and ER; 3. Advise the ER on the effectiveness of the proposed remedial measures; 4. Repeat measurements to confirm findings; 5. Increase monitoring frequency to daily; 6. Discuss with IEC and Contractor on remedial actions required; 7. If exceedance continues, arrange meeting with IEC and ER; 8. If exceedance stops, cease additional monitoring.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ET on the effectiveness of the proposed remedial measures; 5. Monitor the implementation of remedial measures.	in writing; 2. Notify Contractor; 3. Ensure remedial measures properly	Submit proposals for remedial to ER within 3 working days of notification;     Implement the agreed proposals;     Amend proposal if appropriate.
Limit Level				
Exceedance for one sample	I. Identify source, investigate the causes of exceedance and propose remedial measures;     Inform ER, Contractor and EPD;     Repeat measurement to confirm finding;     Increase monitoring frequency to daily;     Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Monitor theimplementation of remedial measures.	in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented.	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Amend proposal if appropriate.
Exceedance for two or more consecutive samples	1. Notify IEC, ER, Contractor and EPD; 2. Identify source; 3. Repeat measurement to confirm findings; 4. Increase monitoring frequency to daily; 5. Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC	1. Check monitoring data submitted by ET; 2. Check Contractor's working method; 3. Discuss amongst ER, ET, and Contractor on the potential remedial actions; 4. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise	Notify Contractor;     In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented;     Ensure remedial measures properly implemented;	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not
	and ER to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring.	the ER accordingly; 5. Monitor the implementation of remedial measures.	<ol> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	under control; 5. Stop the relevar portion of works as determined by the ER until the exceedance is abated.



## **Event and Action Plan for Construction Noise**

Event	ET	IEC	ER	Action Contractor
Action Level	1. Notify ER, IEC and Contractor; 2. Carry out investigation; 3. Report the results of investigation to the IEC, ER and Contractor; 4. Discuss with the IEC and Contractor on remedial measures required; 5. Increase monitoring frequency to check mitigation effectiveness.	Review the investigation results submitted by the ET;     Review the proposed remedial measures by the Contractor and advise the ER accordingly;     Advise the ER on the effectiveness of the proposed remedial measures.	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures.	Submit noise mitigation proposals to IEC and ER;     Implement noise mitigation proposals.
Limit Level	1. Inform IEC, ER, Contractor and EPD; 2. Repeat measurements to confirm findings; 3. Increase monitoring frequency; 4. Identify source and investigate the cause of exceedance; 5. Carry out analysis of Contractor's working procedures; 6. Discuss with the IEC, Contractor and ER on remedial measures required; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; 8. If exceedance stops, cease additional monitoring.	Discuss amongst ER, ET, and Contractor on the potential remedial actions;     Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly.	1. Confirm receipt of notification of failure in writing: 2. Notify Contractor; 3. In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented; 4. Supervise the implementation of remedial measures; 5. If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated.	1. Take immediate action to avoid further exceedance: 2. Submit proposals for remedial actions to IEC and ER within 3 working days of notification; 3. Implement the agreed proposals; 4. Submit further proposal if problem still not under control; 5. Stop the relevant portion of works as instructed by the ER until the exceedance is abated.



# **Event and Action Plan for Water Quality**

EVENT				ACTION
Action level being exceeded by one sampling day	1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and Contractor; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC and Contractor; 6. Repeat measurement on next day of exceedance.	1. Discuss with ET and Contractor on the mitigation measures; 2. Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; 3. Assess the effectiveness of the implemented mitigation measures	1. Discuss with IEC on the proposed mitigation measures; 2. Make agreement on the mitigation measures to be implemented; 3. Assess the effectiveness of the implemented mitigation measures	1. Inform the ER and confirm notification of the non-compliance in writing; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Discuss with ET and IEC and propose mitigation measures to IEC and ER; 6. Implement the agreed mitigation measures.
Action Level being exceeded by more than two consecutive sampling days	1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC and Contractor; 4. Check monitoring data, all plant, equipment and Contractor's working measures with IEC and Contractor; 5. Discuss mitigation measures with IEC and Contractor; 6. Ensure mitigation measures are implemented; 7. Prepare to increase the monitoring frequency to daily; 8. Repeat measurement on next day of	Discuss with ET and Contractor on the mitigation measures;     Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly;     Assess the effectiveness of the implemented mitigation measures	Discuss with IEC on the proposed mitigation measures;     Make agreement on the mitigation measures to be implemented;     Assess the effectiveness of the implemented mitigation measures	1. Inform the ER and confirm notification of the non-compliance in writing; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Discuss with ET and IEC and propose mitigation measures to IEC and ER within 2 working days: 6. Implement the agreed mitigation measures.
Limit Level being exceeded by one sampling day	exceedance.  1. Repeat in-situ measurement to confirm findings;  2. Identify reasons for non-compliance and sources of impact;  3. Inform IEC, Contractor and EPD;  4. Check monitoring data, all plant, equipment and Contractor's working methods;  5. Discuss mitigation measures with IEC, ER and Contractor;  6. Ensure mitigation measures are implemented;  7. Increase the monitoring frequency to daily until no exceedance of Limit	Discuss with ET and Contractor on the mitigation measures;     Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly;     Assess the effectiveness of the implemented mitigation measures	Discuss with IEC, ET and Contractor on the proposed mitigation measures;     Request Contractor to critically review the working methods;     Make agreement on the mitigation measures to be implemented;     Assess the effectiveness of the implemented mitigation measures	Inform the ER and confirm notification of the non-compliance in writing:     Rectify unacceptable practice;     Check all plant and equipment;     Consider changes of working methods;     Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days;     Implement the agreed mitigation measures.
Limit level being exceeded by more than one consecutive sampling days	Level.  1. Repeat in-situ measurement to confirm findings; 2. Identify reasons for non-compliance and sources of impact; 3. Inform IEC, Contractor and EPD; 4. Check monitoring data, all plant, equipment and Contractor's working methods; 5. Discuss mitigation measures with IEC, ER and Contractor; 6. Ensure mitigation measures are implemented; 7. Increase the monitoring frequency to daily until no exceedance of Limit Level for two consecutive days.	Discuss with ET and Contractor on the mitigation measures;     Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly;     Assess the effectiveness of the implemented mitigation measures.	1. Discuss with IEC, ET and Contractor on the proposed mitigation measures; 2. Request Contractor to critically review the working methods; 3. Make agreement on the mitigation measures to be implemented; 4. Assess the effectiveness of the implemented mitigation measures; 5. Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the construction activities until no exceedance of Limit Level.	1. Inform the ER and confirm notification of the non-compliance in writing; 2. Rectify unacceptable practice; 3. Check all plant and equipment; 4. Consider changes of working methods; 5. Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; 6. Implement the agreed mitigation measures; 7. As directed by the ER, to slow down or to stop all or part of the construction activities.



# Appendix H

**Impact Monitoring Schedule** 



### Impact Monitoring Schedule for Reporting Period – July 2022

	Date		onitoring	Noise Monitoring	Water Quality
Fri	1-Jul-22	1-hour TSP	24-hour TSP		- ·
		AM2 6- AM2*	AM4b, AM5, AM6 &		All Water Quality Monitoring
Sat	2-Jul-22	AM2&AM3*	AM7b		Locations *
Sun	3-Jul-22	AM2 CAM2 AM4h		NIM2 NIM4 NIM5 0	All Water On Site Manitoning
Mon	4-Jul-22	AM2&AM3, AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	All Water Quality Monitoring Locations
Tue	5-Jul-22				
Wed	6-Jul-22		AM2&AM3		All Water Quality Monitoring Locations
Thu	7-Jul-22				
Fri	8-Jul-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	All Water Quality Monitoring Locations
Sat	9-Jul-22	AM4b, AM5, AM6 & AM7b			
Sun	10-Jul-22				
Mon	11-Jul-22				All Water Quality Monitoring Locations
Tue	12-Jul-22		AM2&AM3		
Wed	13-Jul-22				All Water Quality Monitoring Locations
Thu	14-Jul-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	
Fri	15-Jul-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	All Water Quality Monitoring Locations
Sat	16-Jul-22				
Sun	17-Jul-22				
Mon	18-Jul-22		AM2&AM3		All Water Quality Monitoring Locations
Tue	19-Jul-22				
Wed	20-Jul-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	All Water Quality Monitoring Locations
Thu	21-Jul-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	
Fri	22-Jul-22				All Water Quality Monitoring Locations
Sat	23-Jul-22		AM2&AM3		
Sun	24-Jul-22				
Mon	25-Jul-22				All Water Quality Monitoring Locations
Tue	26-Jul-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	
Wed	27-Jul-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	All Water Quality Monitoring Locations
Thu	28-Jul-22				
Fri	29-Jul-22		AM2&AM3		All Water Quality Monitoring Locations
Sat	30-Jul-22				
Sun	31-Jul-22				

<sup>\*1-</sup>Hour TSP monitoring at AM2&3 and Water Quality Monitoring on 2 July 2022 were cancelled due to adverse weather condition (Typhoon Signal No. 8 in force). The 1-hour TSP monitoring at AM2&3 was rescheduled to 4 July 2022.

Monitoring Day
Sunday or Public Holiday



### Impact Monitoring Schedule for next Reporting Period – August 2022

	Date	Dust Mo		Noise Monitoring	Water Quality
	Date	1-hour TSP	24-hour TSP	Noise Monitoring	-
Mon	1-Aug-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	All Water Quality Monitoring Locations
Tue	2-Aug-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	
Wed	3-Aug-22				All Water Quality Monitoring Locations
Thu	4-Aug-22		AM2&AM3		
Fri	5-Aug-22				All Water Quality Monitoring Locations
Sat	6-Aug-22	AM2&AM3	AM4b, AM5, AM6 & AM7b		
Sun	7-Aug-22				
Mon	8-Aug-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	All Water Quality Monitoring Locations
Tue	9-Aug-22				
Wed	10-Aug-22		AM2&AM3		All Water Quality Monitoring Locations
Thu	11-Aug-22				
Fri	12-Aug-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	All Water Quality Monitoring Locations
Sat	13-Aug-22	AM4b, AM5, AM6 & AM7b			
Sun	14-Aug-22				
Mon	15-Aug-22				All Water Quality Monitoring Locations
Tue	16-Aug-22		AM2&AM3		
Wed	17-Aug-22				All Water Quality Monitoring Locations
Thu	18-Aug-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	
Fri	19-Aug-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	All Water Quality Monitoring Locations
Sat	20-Aug-22				
Sun	21-Aug-22				
Mon	22-Aug-22		AM2&AM3		All Water Quality Monitoring Locations
Tue	23-Aug-22				
Wed	24-Aug-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	All Water Quality Monitoring Locations
Thu	25-Aug-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	
Fri	26-Aug-22				All Water Quality Monitoring Locations
Sat	27-Aug-22		AM2&AM3		
Sun	28-Aug-22				
Mon	29-Aug-22				All Water Quality Monitoring Locations
Tue	30-Aug-22	AM2&AM3	AM4b, AM5, AM6 & AM7b	NM2a	
Wed	31-Aug-22	AM4b, AM5, AM6 & AM7b		NM3, NM4, NM5 & NM6	All Water Quality Monitoring Locations

Monitoring Day
Sunday or Public Holiday



# **Appendix I**

**Database of Monitoring Result** 



## **24-hour TSP Monitoring Data**

DATE	SAMPLE NUMBER		APSED TIM		CHAR			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER (	g)	DUST WEIGHT COLLECTED	24-HR TSP (μg/m³)
	NUMBER	INITIAL	FINAL	(min)	MIN	MAX	AVG	(℃)	(hPa)	(m³/min)	(std m <sup>3</sup> )	INITIAL	FINAL	(g)	(μg/III )
AM2 - Villag	ge House n														
6-Jul-22	28468	16514.58	16538.58	1440	41	42	41.5	28.8	1005.7	1.24	1783	2.6233	2.6997	0.0764	43
12-Jul-22	28476	16538.58	16562.58	1440	40	41	40.5	31.1	1006.9	1.20	1730	2.6197	2.6869	0.0672	39
18-Jul-22	28490	16562.58	16586.58	1440	40	41	40.5	28.8	1005.6	1.21	1736	2.6008	2.6727	0.0719	41
23-Jul-22	28247	16586.58	16610.58	1440	40	40	40.0	31.4	1008.7	1.19	1707	2.8050	2.9146	0.1096	64
29-Jul-22	28535	16610.58	16634.58	1440	40	40	40.0	31.7	1004.7	1.18	1703	2.6697	2.8228	0.1531	90
AM3 - Ta K					Ling Vi										
6-Jul-22	28467	20159.58	20183.58	1440	44	45	44.5	28.8	1005.7	1.47	2115	2.6124	2.6707	0.0583	28
12-Jul-22	28477	20183.58	20207.58	1440	43	44	43.5	31.1	1006.9	1.44	2070	2.6223	2.6803	0.0580	28
18-Jul-22	28491	20207.58	20231.58	1440	43	44	43.5	28.8	1005.6	1.44	2075	2.6102	2.6981	0.0879	42
23-Jul-22	28246	20231.58	20255.58	1440	43	44	43.5	31.4	1008.7	1.44	2071	2.787	2.9014	0.1144	55
29-Jul-22	28534	20255.58	20279.58	1440	44	45	44.5	31.7	1004.7	1.46	2106	2.6788	2.8348	0.1560	74
AM4b - Hou	ise no. 10B	1 Nga Yiu	Ha Village												
2-Jul-22	28448	19563.47	19587.49	1441	45	45	45.0	26.9	999.1	1.37	1979	2.7630	2.7906	0.0276	14
8-Jul-22	28469	19587.49	19611.49	1440	39	40	39.5	30	1007.4	1.17	1689	2.6192	2.6445	0.0253	15
14-Jul-22	28478	19611.49	19635.49	1440	44	45	44.5	30.4	1005.6	1.35	1946	2.5995	2.6292	0.0297	15
20-Jul-22	28530	19635.49	19659.49	1440	44	45	44.5	30.8	1009.8	1.35	1949	2.6807	2.7500	0.0693	36
26-Jul-22	28308	19659.49	19683.49	1440	44	45	44.5	31.2	1007.7	1.35	1945	2.7655	2.7949	0.0294	15
AM5a - Ping	y Yeung Vi	llage Hous	e												
2-Jul-22	28447	18392.32	18416.33	1441	41	42	41.5	26.9	999.1	1.37	1968	2.7614	2.7916	0.0302	15
8-Jul-22	28470	18416.33	18440.33	1440	40	41	40.5	30	1007.4	1.33	1917	2.6241	2.6487	0.0246	13
14-Jul-22	28479	18440.33	18464.33	1440	40	40	40.0	30.4	1005.6	1.31	1890	2.6093	2.6392	0.0299	16
20-Jul-22	28498	18464.33	18488.33	1440	42	43	42.5	30.8	1009.8	1.40	2012	2.6276	2.6488	0.0212	11
26-Jul-22	28527	18488.33	18512.33	1440	41	41	41.0	31.2	1007.2	1.35	1937	2.6477	2.6856	0.0379	20
AM6 - Wo k	Keng Shan	Village Ho													
2-Jul-22	28446	16047.58	16071.58	1440	40	40	40.0	26.9	999.1	1.25	1802	2.7662	2.7971	0.0309	17
8-Jul-22	28471	16071.58	16095.58	1440	39	40	39.5	30.0	1007.4	1.23	1777	2.6124	2.6545	0.0421	24
14-Jul-22	28485	16095.58	16119.58	1440	41	42	41.5	30.4	1005.6	1.30	1866	2.6059	2.6745	0.0686	37
20-Jul-22	28497	16119.58	16143.58	1440	39	40	39.5	30.8	1009.8	1.23	1777	2.6042	2.6523	0.0481	27
26-Jul-22	28526	16143.58	16167.58	1440	39	39	39.0	31.2	1007.7	1.22	1751	2.6490	2.7453	0.0963	55
AM7b - Loi	Tung Villa	ge House													
2-Jul-22	28438	25069.99	25093.99	1440	43	43	43	26.9	999.1	1.31	1883	2.7661	2.7962	0.0301	16
8-Jul-22	28472	25093.99	25117.99	1440	42	43	42.5	30	1007.4	1.29	1860	2.6068	2.6428	0.0360	19
14-Jul-22	28486	25117.99	25141.99	1440	42	42	42	30.4	1005.6	1.28	1836	2.616	2.6517	0.0357	19

Agreement No. CE 45/2008 (CE)
Liantang/Heung Yuen Wai Boundary Control Point and Associated Works
Monthly Environmental Monitoring & Audit Report (No.108) – July 2022



DATE	SAMPLE NUMBER		APSED TIM	ſE	CHAR	T REA	ADING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER (	WEIGHT g)	DUST WEIGHT COLLECTED	24-HR TSP
51112	NUMBER	INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m <sup>3</sup> )	INITIAL	FINAL	(g)	$(\mu g/m^3)$
20-Jul-22	28496	25141.99	25165.99	1440	42	43	42.5	30.8	1009.8	1.29	1860	2.6063	2.6389	0.0326	18
26-Jul-22	28525	25165.99	25189.99	1440	40	40	40	31.2	1007.7	1.22	1751	2.6444	2.6921	0.0477	27



Construction Noise Monitoring Results, dB(A)

Date	Start Time	1 <sup>st</sup> Leq <sub>5min</sub>	L10	L90	2 <sup>nd</sup> Leq <sub>5min</sub>	L10	L90	3 <sup>nd</sup> Leq <sub>5min</sub>	L10	L90	4 <sup>th</sup> Leq <sub>5min</sub>	L10	L90	5 <sup>th</sup> Leq <sub>5min</sub>	L10	L90	6 <sup>th</sup> Leq <sub>5min</sub>	L10	L90	Leq30	façade correction
NM2a - Villa	ge Hou	se near l	Lin Ma	Hang l	Road			-			-		-	-		-	<del>-</del>				
8-Jul-22	11:09	66.5	65.5	48	61.2	62.5	46.5	54.7	62	45	50.8	55	48.5	49.6	56	46	48.2	53.5	44.5	60	63
14-Jul-22	10:16	57.7	58.8	54.6	58.7	61.5	54.5	64.7	67.5	57	64.1	68	58.9	61.1	62.6	56.9	61.8	64.2	57	62	65
20-Jul-22	9:48	66.8	69.4	50.4	62	64.8	50.1	58.5	62.5	48.6	60.7	62.7	47.3	59.5	62.6	47	60.6	63.9	48.1	62	65
26-Jul-22	10:06	57.7	60.8	54.6	61.1	63.4	55.5	58.7	62.6	54.6	59.5	62.6	54.4	59.1	62	55.5	58.6	61.7	54.4	59	62
NM3 - Ping	Yeung V	illage H	ouse																		
4-Jul-22	13:30	61.1	62.0	57.9	58.8	61.8	55.7	57.6	59.3	55.1	62.1	63.9	58.2	61.1	62.4	59.3	62.8	65.9	59.4	61	NA
15-Jul-22	10:42	63.6	67.5	55.0	61.2	65.5	56.0	58.6	62.5	53.5	60.7	63.5	55.0	59.2	64.5	56.0	61.6	63.5	58.5	61	NA
21-Jul-22	9:38	63.8	66.5	53.0	58.8	62.0	52.5	65.2	67.0	55.0	60.2	64.0	55.0	60.7	63.5	53.5	61.2	63.5	56.0	62	NA
27-Jul-22	10:26	58.6	63.5	55.0	61.7	65.0	55.0	64.8	67.5	58.5	61.7	65.0	58.0	59.6	63.5	56.5	62.2	64.5	58.5	62	NA
NM4 - Wo K	I - I				I I																
4-Jul-22	14:07	67.7	71.7	58.9	71.1	73.9	62.7	68.9	71	61.3	68.1	71.5	61.7	67.7	69.3	65.8	67.7	69.8	58.9	69	NA
15-Jul-22	11:24	60.2	65.5	57	58.8	63.5	55	56.2	63	53	52.6	59	51	58.1	63.5	53	60.7	65	56	58	NA
21-Jul-22	10:19	67.7	68.5	58.5	65.2	67	55	63.7	66.5	54	62.9	65	53.5	65.6	68	52.5	63.8	67.5	53	65	NA
27-Jul-22	11:23	66.7	68.5	56.5	63.8	67	55	63.6	67.5	55.5	62.1	65	56.5	65.5	67.5	56.5	65.2	68	55	65	NA
NM5- Ping Y				40	50.7		40.5		~ .	44.5	40.7	50.5	44.5	164		10.5	40.1		4.5	~ 1	N. T. A
4-Jul-22	10:19	52.8	61	49	53.7	62	48.5	51.1	56	44.5	48.7	53.5	44.5	46.4	55	43.5	49.1	53.5	45	51	NA
15-Jul-22	13:38	52.3	58.5	49.5	53.3	59.5	52	51.8	62	50	52.6	58	48.5	53.7	60.5	49	50.2	56.5	46	52	NA
21-Jul-22	11:07	54.2	56.5	48	56.3	61.5	45.5	58.2	63	47.5	52.9	53.5	48	53.6	55	48	49.8	52.5	43.5	52	NA
27-Jul-22	13:46	52.6	57.5	48.5	53.8	62	49.5	51.6	58.5	44	50.8	55.5	43.5	52.6	56	44	48.9	53.5	44.5	55	NA
NM6 – Tai To						62.5	50.5		62.5	~ ~	<b>72.</b> 0	50	40.5	50.0	<u> </u>	46.5	7.50		17. 7		27.4
4-Jul-22	11:16	57.6	62	53.5	56.6	62.5	52.5	59.2	63.5	55	52.9	59	48.5	50.2	61	46.5	56.3	62	47.5	56	NA
15-Jul-22	13:02	56.6	62.5	53.5	57.4	63	55.5	56.7	62.5	53.5	58.2	63.5	55.5	55.7	62.5	53.5	57.1	63	52.5	57	NA
21-Jul-22	13:08	58.7	63	52.5	56.2	60	48.5	58.1	61.5	48	60.1	62	48	59.3	63.5	52.5	61.3	62.5	49	59	NA
27-Jul-22	13:03	58.2	63	53.5	56.7	63.5	52.5	53.2	58.5	51	56.4	60	48.5	58.6	62	50	57.8	61.5	49.5	57	NA



## Water Quality Monitoring Data for Contract 6

				ter Quarity Monitori				
Date	4-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM1-C	11:30	0.25	26.2 26.2 26.2	5.44 5.41 5.4	67.3 67.0 67.2	130.0 131.0 130.5	8.33 8.33 8.3	140 120 130.0
WM1	11:10	0.21	25.4 25.4 25.4	7.45 7.44 7.44	91.0 90.8 90.9	36.2 34.3 35.3	7.49 7.49 7.5	39 38 38.5
Date	6-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM1-C	11:00	0.26	26 26 26.0	4.63 4.64 4.64	57.1 57.2 57.2	65.2 68.1 66.7	7.92 7.92 7.92	84 86 85.0
WM1	10:40	0.17	26.1 26.1 26.1	6.7	82.6 81.1 81.9	49.8 49.3	7.65 7.65	94 94.0
Date	8-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM1-C	11:15	0.25	27.4 27.4 27.4	7.29 7.19 7.2	91.8 91.3	12.2	7.49 7.5	11 10.5
WM1	10:55	0.20	27.3 27.3 27.3	7.36 7.33 7.3	92.4 91.9 92.2	50.8 50.1 50.5	8.04 8.04 8.0	54 52 53.0
Date	11-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM1-C	11:10	0.25	<u>27.7</u> 27.7	7.61 7.62 7.6	97.2 97.1 97.2	10.3	7.39 7.4	5 5.0
WM1	10:50	0.18	27.5 27.5 27.5	7.49 7.51 7.51	94.6 94.7	30.1 30.2	8.13 8.13 8.1	40 40.5
<u> </u>								
Date	13-Jul-22					T	ı	T
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	pH	SS(mg/L)
WM1-C	11:20	0.08	28.6 28.6 28.6	8.08 8.11 8.1	104.3 104.6 104.5	31.8 31.7 31.8	7.61       7.61       7.61	62 63.0
WM1	11:00	0.17	27.5 27.5 27.5	7.53 7.54 7.54	95.3 95.5 95.4	48.6 47.9	7.97 7.97 8.0	56 56 56



Date	15-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS(	mg/L)
WM1-C	11:10	0.10	28.2 28.2	28.2	8.24 8.27	8.3	105.6 106.0	105.8	127.0 129.0	128.0	7.68 7.68	7.7	268 171	219.5
WM1	10:50	0.17	27.4 27.4	27.4	7.24 7.2	7.2	91.3 90.8	91.1	101.2 98.7	100.0	7.97 7.97	8.0	124 123	123.5
Date	18-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)		ty (NTU)	р	Н		mg/L)
WM1-C	16:50	0.13	29.2 29.2	29.2	7.62 7.64	7.6	99.5 99.7	99.6	68.2 72.1	70.2	7.68 7.68	7.7	76 100	88.0
WM1	16:40	0.25	29 29	29.0	7.31 7.3	7.3	95.1 95.0	95.1	72.3 71.3	71.8	7.74 7.74	7.7	100 102	101.0
					•	•	•							
Date	20-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS(	mg/L)
WM1-C	11:30	0.13	28.8 28.8	28.8	7.53 7.51	7.5	98.0 97.7	97.9	226.0 195.0	210.5	8.08 8.08	8.1	440	438.5
WM1	11:10	0.20	28.8 28.8	28.8	7.13 7.11	7.1	92.3 92.1	92.2	113.0 121.0	117.0	7.86 7.86	7.9	152 150	151.0
Date	22-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)		ty (NTU)	р	Н		mg/L)
WM1-C	11:25	0.13	30.5 30.5	30.5	7.66 7.68	7.7	102.3 102.5	102.4	67.2 65.7	66.5	7.82 7.82	7.8	67 68	67.5
WM1	11:05	0.23	30.6 30.6	30.6	7.73 7.74	7.7	103.8 104.0	103.9	43.6 43.8	43.7	7.86 7.86	7.9	38 37	37.5
Date	25-Jul-22		ı		Г									
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)		ty (NTU)	р	Н		mg/L)
WM1-C	11:20	0.11	30.7 30.7	30.7	8.07 8.13	8.1	108.2 108.9	108.6	13.7 13.6	13.7	8.15 8.15	8.2	15 14	14.5
WM1	11:00	0.15	29.6 29.6	29.6	7.41 7.45	7.4	97.8 98.9	98.4	40.4 39.8	40.1	8.06 8.06	8.1	44	43.5



Date	27-Jul-22													
Location	Time	Depth (m)	Temp	(OC)	D0 (r	ng/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS(	(mg/L)
WM1-C	11:30	0.02												
WM1	11:15	0.15	30.1 30.1	30.1	7.76 7.77	7.8	102.9 103.0	103.0	37.1 36.5	36.8	8.13 8.13	8.1	31 30	30.5

Date	29-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbidi	ty (NTU)	р	Н	SS(	mg/L)
WM1-C	13:00	0.02												
WM1	12:45	0.16	31.2 31.2	31.2	7.32 7.33	7.3	98.9 99.0	99.0	24.7 25.8	25.3	8.13 8.13	8.1	52 54	53.0



## Water Quality Monitoring Data for Contract 6

Date	4-Jul-22													
Location	Time	Depth (m)	Temp (oC)		DO (r	mg/L)	DO	(%)	Turbio	dity (NTU)	р	Н	SS(ı	mg/L)
WM2A-C	12:10	0.25	25 25	25.0	7.15 7.1	7.1	92.4 91.8	92.1	6.1	6.2	7.15 7.15	7.2	12 11	11.5
WM2A	11:50	0.17	25.1 25.1	25.1	7.02 7.01	7.0	85.1 85.0	85.1	6.9	6.9	7.61 7.61	7.6	6 7	6.5

Date	6-Jul-22													
Location	Time	Depth (m)	Temp	(OC)	DO (r	mg/L)	DO	(%)	Turbio	dity (NTU)	р	Н	SS(r	mg/L)
WM2A-C	11:40	0.26	25.8 25.8	25.8	7.21 7.17	7.2	92.5 91.9	92.2	7.1 7.1	7.1	7.31 7.31	7.3	12 12	12.0
WM2A	11:20	0.16	26.1 26.1	26.1	7.46 7.47	7.5	92.2 92.3	92.3	19.8 20.1	20.0	7.44 7.44	7.4	13 14	13.5

Date	8-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	DO (r	mg/L)	DO	(%)	Turbio	dity (NTU)	р	Н	SS(ı	mg/L)
WM2A-C	11:55	0.27	25.9	25.9	7.58	7.6	93.3	93.4	213.0	212.0	7.99	8.0	300	301.5
VVIVIZA-C	11.00	0.27	25.9	20.9	7.59	7.6	93.4	93.4	211.0	212.0	7.99	0.0	303	301.5
\	11.05	0.17	26.8	27.0	7.29	7.0	91.1	91.0	11.5	11 [	7.71	7 7	11	11 5
WM2A	11:35	0.17	26.8	26.8	7.27	7.3	90.9	91.0	11.5	11.5	7.71	7.7	12	11.5

Date	11-Jul-22													
Location	Time	Depth (m)	Temp	(OC)	DO (r	mg/L)	DO	(%)	Turbio	dity (NTU)	р	Н	SS(r	mg/L)
WM2A-C	11.50	0.25	27.1	27.1	6.81	/ 0	90.2	00.1	171.1	170 /	7.33	7.0	231	222.0
VVIVIZA-C	11:50	0.25	27.1	27.1	6.78	6.8	89.9	90.1	170.1	170.6	7.33	7.3	235	233.0
\	11.20	0.17	28.2	20.2	6.51	/ -	83.5	02.0	13.6	10 /	7.61	7 /	8	7 -
WM2A	11:30	0.17	28.2	28.2	6.41	6.5	82.2	82.9	13.5	13.6	7.61	7.6	7	7.5

Date	13-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	DO (r	mg/L)	DO	(%)	Turbio	dity (NTU)	р	Н	SS(ı	mg/L)
WM2A-C	12.00	0.25	28	28.0	6.68	6 7	89.3	89.1	164.0	163.0	7.40	7.4	291	287.0
VVIVIZA-C	12:00	0.25	28	20.0	6.65	6.7	88.9	09.1	162.0	103.0	7.40	7.4	283	207.0
\	11.40	0.1/	28.5	20 F	6.37	/ /	82.1	01.0	8.4	0.4	7.78	7.0	10	10.0
WM2A	11:40	0.16	28.5		81.5	81.8	8.4	8.4	7.78	7.8	10	10.0		



Date	15-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	DO (r	mg/L)	DO	(%)	Turbid	ity (NTU)	pl	H	SS(ı	mg/L)
WM2A-C	11:50	0.24	27.5 27.5	27.5	6.49 6.45	6.5	89.8 89.2	89.5	132.0 133.0	132.5	7.37	7.4	174 315	244.5
WM2A	11:30	0.15	27.8 27.8	27.8	6.08 6.07	6.1	77.3 77.1	77.2	22.7 22.6	22.7	7.97 7.97	8.0	26 26	26.0
5 .	10 1 100	Ι												
Date	18-Jul-22	D 11 ( )		( 0)	DO /	// \		(0/)		'. /NITLIN	Ι .	1	00/	(1.)
Location	Time	Depth (m)	Temp	(OC)	DO (r	ng/L)		(%)		ity (NTU)	7.40	<u> </u>		mg/L)
WM2A-C	17:15	0.25	28.4 28.4	28.4	7.05 7.03	7.0	94.3 94.0	94.2	7.4	7.4	7.60	7.6	14 18	16.0
WM2A	17:00	0.16	28.8 28.8	28.8	5.87 5.86	5.9	76.1 76.0	76.1	8.9 9.0	8.9	7.86 7.86	7.9	8 9	8.5
							•							
Date	20-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	DO (r	mg/L)	DO	(%)	Turbid	ity (NTU)	pl	Н	SS(ı	mg/L)
WM2A-C	12:10	0.23	27.6 27.6	27.6	7.04	7.0	94.8	94.5	5.5 5.4	5.5	7.72	7.7	17 16	16.5
WM2A	11:50	0.16	27.9 27.9	27.9	6.16 6.08	6.1	78.5 77.5	78.0	15.6 15.1	15.4	8.07 8.07	8.1	20 18	19.0
							•							
Date	22-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbid	ity (NTU)	pl	Н	SS(ı	mg/L)
WM2A-C	12:05	0.25	30.1 30.1	30.1	7.2 7.14	7.2	95.5 94.9	95.2	6.3	6.3	8.02	8.0	13 13	13.0
WM2A	11:45	0.15	30.2 30.2	30.2	6.31 6.24	6.3	83.7 82.7	83.2	8.7 8.7	8.7	8.09	8.1	5 4	4.5
		1												
Date	25-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)		(%)	1	ity (NTU)	pl	Η		mg/L)
WM2A-C	12:00	0.25	29.1 29.1	29.1	6.85 6.82	6.8	92.8 92.4	92.6	6.0 5.9	5.9	8.08	8.1	13 12	12.5
WM2A	11:40	0.16	29.3 29.3	29.3	6.9 6.89	6.9	90.1	90.1	7.3 7.3	7.3	7.23 7.23	7.2	3 4	3.5



Date	27-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	DO (r	mg/L)	DO	(%)	Turbio	lity (NTU)	р	Н	SS(ı	mg/L)
WM2A-C	12:00	0.24	28.9 28.9	28.9	6.97 6.9	6.9	94.6 93.8	94.2	5.1 5.1	5.1	7.82 7.82	7.8	7 8	7.5
WM2A	11:45	0.16	29 29	29.0	6.44 6.35	6.4	83.7 82.4	83.1	7.8 7.9	7.9	8.29 8.29	8.3	7 6	6.5

Date	29-Jul-22													
Location	Time	Depth (m)	Temp	(OC)	DO (r	mg/L)	DO	(%)	Turbio	dity (NTU)	р	Н	SS(ı	mg/L)
WM2A-C	13:40	0.24	30	30.0	6.8	6.8	92.9	92.7	4.9	4.9	7.78	7.8	8	8.0
VVIVIZA-C	13.40	0.24	30	30.0	6.77	0.0	92.5	92.7	4.8	4.9	7.78	7.0	8	6.0
\	12.20	0.14	30.1	20.1	6.6	4 4	87.5	07.2	7.3	7.0	8.29	0.2	5	
WM2A	13:20	0.16	30.1	30.1	6.56	6.6	86.9	87.2	7.3	7.3	8.29	8.3	6	5.5



## Water Quality Monitoring Data for Contract 6

			_ <del></del>	ater Quanty Monitor	ing Duta for Contrac	<u> </u>		
Date	4-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM3-c	12:30	0.13	25.5 25.5 25.5	6.64 6.52	81.1 79.5 80.3	8.6	7.73 7.73	11 11.0
WM3	12:50	0.17	25.4 25.4 25.4	7.22 7.13 7.2	88.0 86.8 87.4	11.5 11.5	8.18 8.18 8.2	13 13 13.0
	T							
Date	6-Jul-22			_	_			_
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM3-c	12:00	0.17	25.4 25.4 25.4	6.82 6.8	83.2 83.0 83.1	245.0 243.0 244.0	7.28 7.28 7.3	398 407 402.5
WM3	12:20	0.20	25.8 25.8 25.8	7.21 7.2	88.5 88.0 88.3	56.1 57.3	7.22 7.22	82 81.0
		•					<u>'</u>	
Date	8-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM3-c	12:15	0.15	26.7 26.7	7 7.0	87.1 86.5 86.8	11.9	7.55 7.5	23 22.5
WM3	12:35	0.16	26.6 26.6 26.6	7.61 7.61 7.61	94.7 94.8	3.6 3.6	7.61 7.61	7 7.0
	•	•	1		1		1	
Date	11-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM3-c	12:10	0.13	27.2 27.2 27.2	5.63 5.61 5.6	70.9 70.8	9.9	7.63 7.63	5.5
WM3	12:30	0.16	26.4 26.4 26.4	7.56 7.55 7.6	94.0 93.9 94.0	4.0 4.0	7.69 7.69 7.7	4 4.0
		•						
Date	13-Jul-22							
Location	Time	Depth (m)	Temp (oC)	DO (mg/L)	DO (%)	Turbidity (NTU)	рН	SS(mg/L)
WM3-c	12:20	0.00						
WM3	12:40	0.15	27.8 27.8 27.8	7.76 7.81 7.8	98.9 99.4 99.2	3.9 3.9	8.1 8.1	5 5.5
	•	•	·				· · · · · · · · · · · · · · · · · · ·	



Date	15-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbidit	ty (NTU)	р	Н	SS(ı	mg/L)
WM3-c	12:10	0.00												
WM3	12:30	0.15	27.8 27.8	27.8	8.01 8.07	8.0	102.1 102.8	102.5	4.5 4.5	4.5	8.24 8.24	8.2	6	6.0
Date	18-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	ty (NTU)	р	Н	SS(ı	mg/L)
WM3-c	17:30	0.00								-				
WM3	17:45	0.15	28.1 28.1	28.1	7.86 7.92	7.9	100.7 101.6	101.2	3.7 3.7	3.7	8.24 8.24	8.2	5 4	4.5
	1	1												
Date	20-Jul-22				1		T		1				1	
Location	Time	Depth (m)	Temp	(oC)	DO (r	ng/L)	DO	(%)	Turbidit	ty (NTU)	р	Н	SS(ı	mg/L)
WM3-c	12:30	0.00												
WM3	12:50	0.14	28.1 28.1	28.1	7.89 7.89	7.9	101.0	101.1	3.1	3.1	8.1 8.1	8.1	4	4.0
Date	22-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbidit	ty (NTU)	р	Н	SS(ı	mg/L)
WM3-c	12:25	0.00												
WM3	12:45	0.16	30.1 30.1	30.1	7.91 7.97	7.9	104.6 105.4	105.0	3.9 3.9	3.9	8.19 8.19	8.2	7 8	7.5
Date	25-Jul-22	1												
Location	Time	Depth (m)	Temp	(oC)	DO (r	na/L)	DO	(%)	Turbidit	ty (NTU)	n	<u>———</u> Н	SSU	mg/L)
WM3-c	12:20	0.00	101110	(==)	23 (1	g/ =/		(, )	. GI SIGI	-	Ρ		33(1	···ÿ/ -/
WM3	12:40	0.15	29.7 29.7	29.7	7.94 8.02	8.0	104.8 105.8	105.3	5.3 5.3	5.3	8.53 8.53	8.5	3 2	2.5



Date	27-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (r	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(r	mg/L)
WM3-c	12:15	0.00												
WM3	12:30	0.15	29.5 29.5	29.5	7.88 7.96	7.9	103.6 104.9	104.3	3.5 3.6	3.6	8.66 8.66	8.7	9 8	8.5

Date	29-Jul-22													
Location	Time	Depth (m)	Temp	(oC)	D0 (n	ng/L)	DO	(%)	Turbidit	y (NTU)	р	Н	SS(r	mg/L)
WM3-c	14:10	0.00												
WM3	14:30	0.14	30.5 30.5	30.5	8.2 8.49	8.3	109.5 113.4	111.5	3.0 3.0	3.0	8.78 8.78	8.8	7 13	10.0





# Appendix J


**Graphical Plots for Monitoring Result** 




#### Air Quality - 1-hour TSP

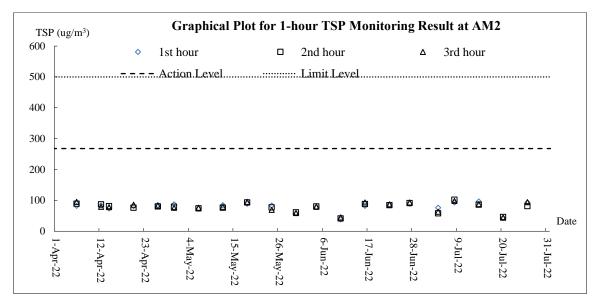


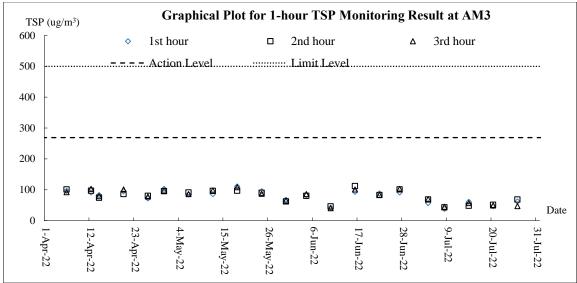


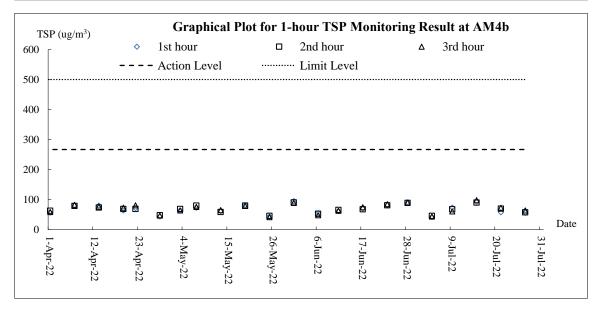



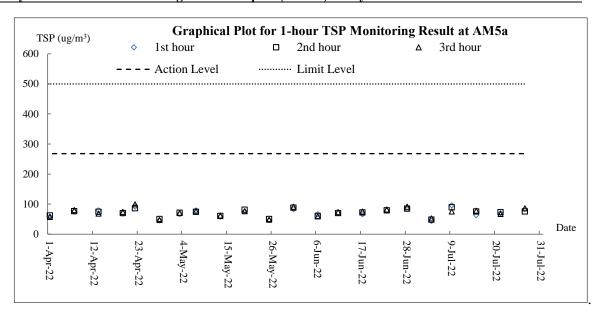


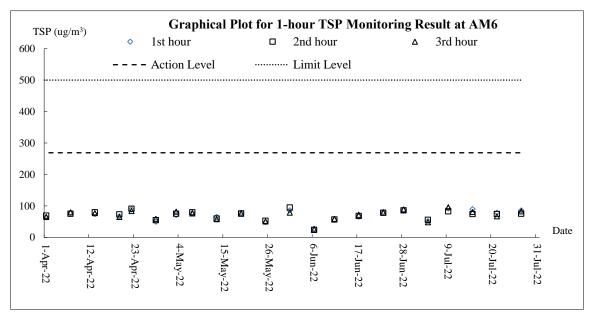


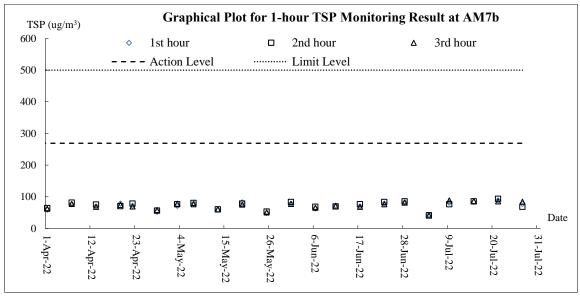





#### Air Quality - 24-hour TSP

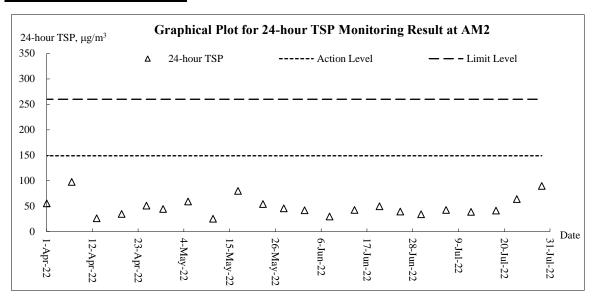


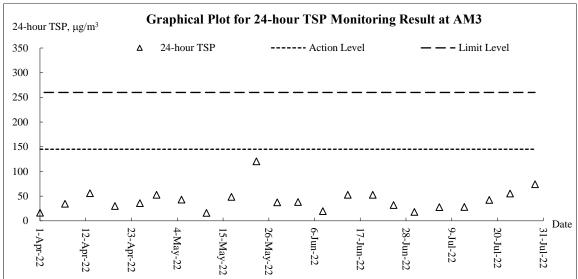


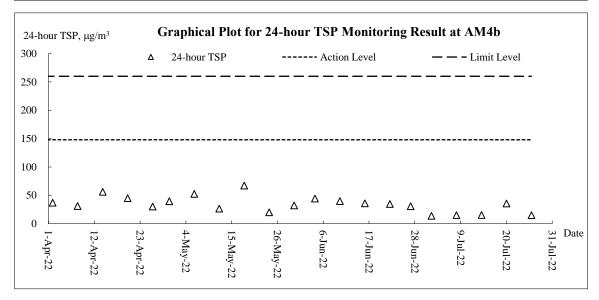



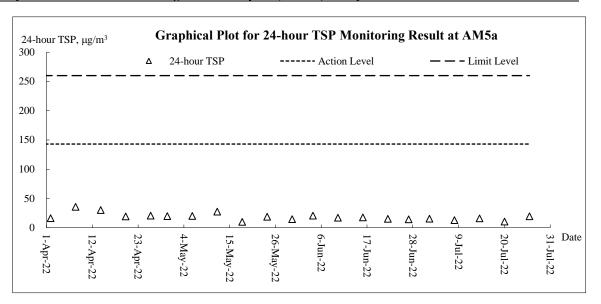


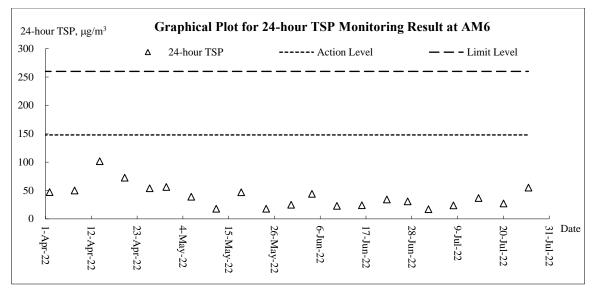


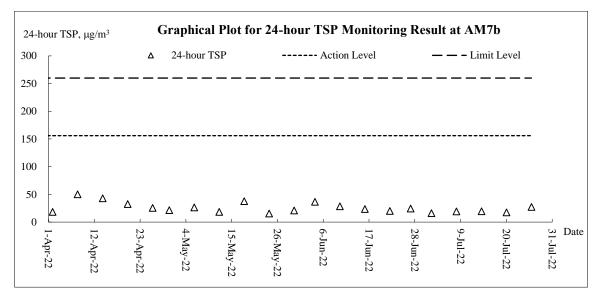





#### **Noise**

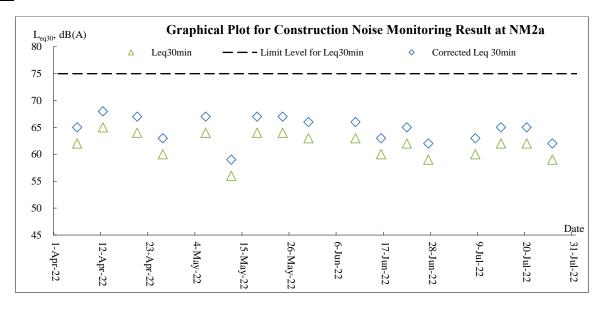


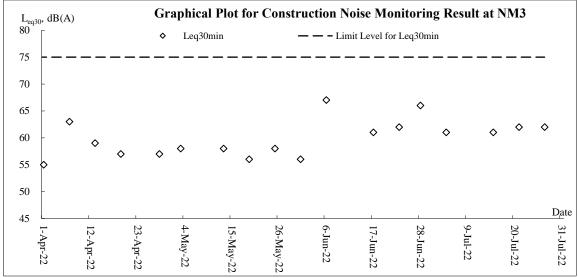

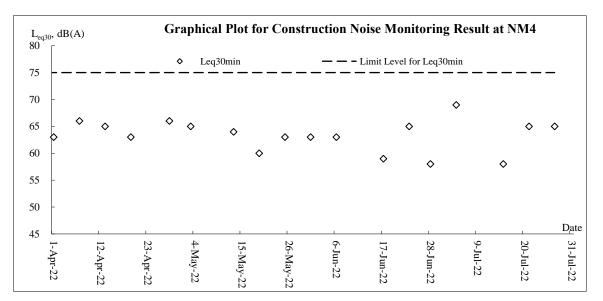




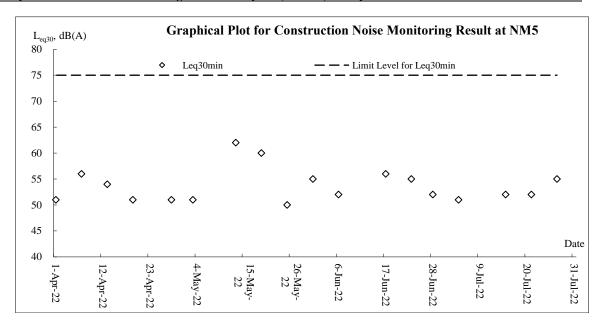


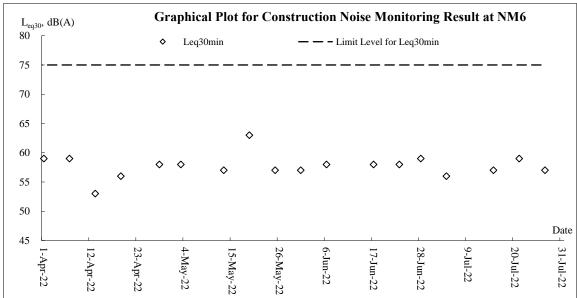





#### **Water Quality**

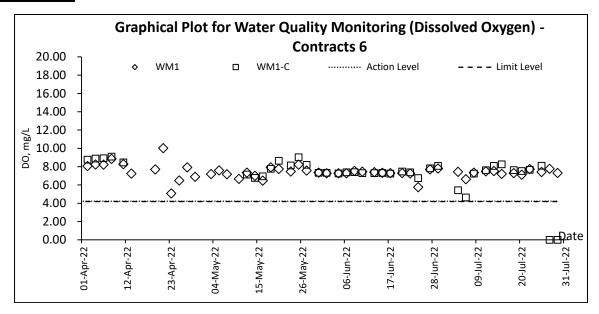


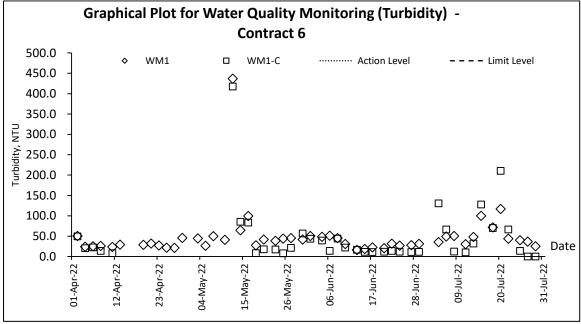


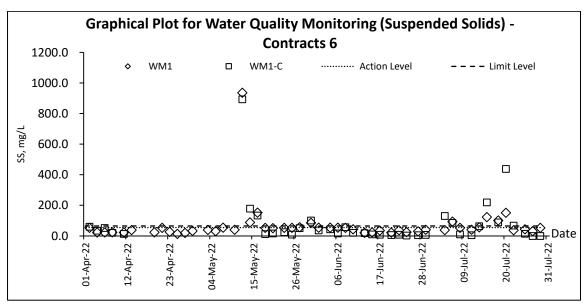




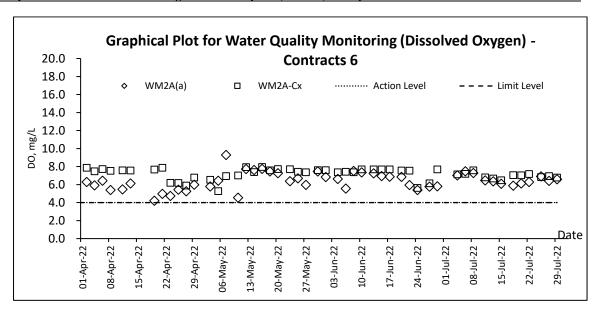


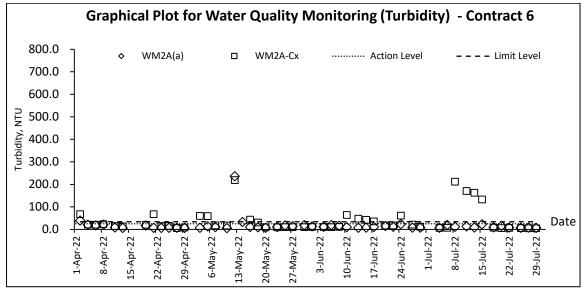


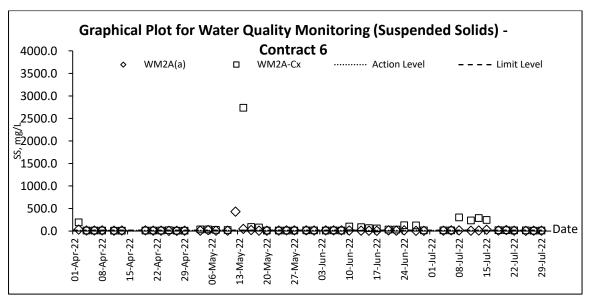



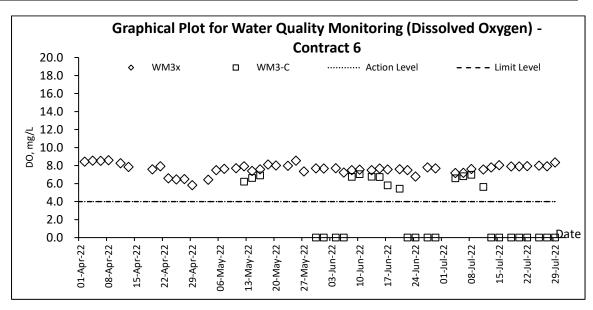

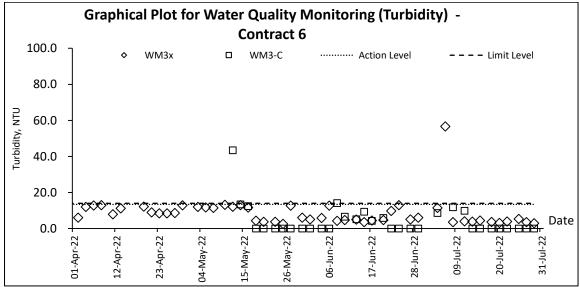

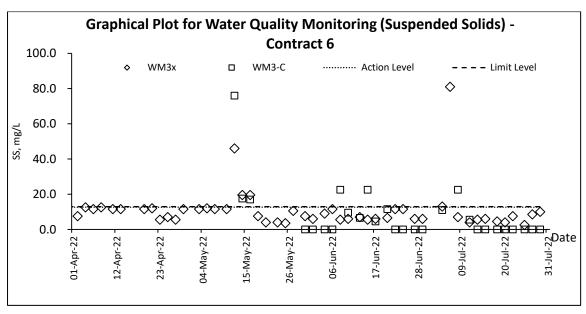



### Appendix K

**Meteorological Data** 



				,	Ta Kwu	Ling Station	<u> </u>
Date		Weather	Total Rainfall (mm)	Mean Air Temp. (°C)	Wind Speed (km/h)	Mean Relative Humidity (%)	Wind Direction
1-Jul-22	Fri	Moderate to fresh easterly winds, strong offshore and on high ground tonight.	63	28.2	15	81.2	E/NE
2-Jul-22	Sat	Moderate to fresh easterly winds, strong offshore and on high ground tonight.	72.4	26.7	23.5	88.5	E/SE
3-Jul-22	Sun	Isolated thunderstorms in the afternoon.	0	29.3	14	76.2	S
4-Jul-22	Mon	Mainly cloudy with a few showers.	0.4	28.4	12	83.7	S/SW
5-Jul-22	Tue	Moderate to fresh southwesterly winds.	0.2	28.4	17.5	86.7	S/SW
6-Jul-22	Wed	Moderate south to southeasterly winds.	0.5	29.0	7	83.2	S/SW
7-Jul-22	Thu	Sunny intervals and a few showers	13.1	29.3	6.2	82.0	E/SE
8-Jul-22	Fri	Hot with sunny periods and isolated showers.	Trace	30.1	8	77.2	Е
9-Jul-22	Sat	Moderate east to southeasterly winds.	Trace	30.6	8.7	78.5	E/SE
10-Jul-22	Sun	t will be fine. Very hot in the afternoon.	Trace	31.2	8	75.0	E/SE
11-Jul-22	Mon	Very hot in the afternoon. Light to moderate easterly winds.	0	30.8	7	76.5	Е
12-Jul-22	Tue	Mainly fine and very hot.	0	30.8	6.2	73.5	E/SE
13-Jul-22	Wed	Light winds, moderate southerlies later.	0	30.6	7	71.5	Е
14-Jul-22	Thu	Hot apart from a few showers.	0	30.8	6.2	73.5	W/SW
15-Jul-22	Fri	Sunny periods in the afternoon.	0.2	30.4	5.5	76.0	W/SW
16-Jul-22	Sat	Light to moderate southwesterly winds.	1.5	31.2	10.5	71.0	W/SW
17-Jul-22	Sun	Very hot. Sunny in the afternoon.	1.2	31.3	11	67.5	SW
18-Jul-22	Mon	Fine tonight. Moderate southwesterly winds.	2.7	31.3	7.5	73.7	S/SW
19-Jul-22	Tue	Mainly fine and very hot apart from isolated showers.	Trace	30.9	8.5	77.0	S/SW
20-Jul-22	Wed	Moderate southerly winds.	0.6	31.3	8.7	75.5	S/SE
21-Jul-22	Thu	Fine and very hot.	0.3	30.9	8	76.2	E/SE
22-Jul-22	Fri	Light to moderate south to southeasterly winds.	0	31.4	4.5	70.0	W/NW
23-Jul-22	Sat	Sunny and very hot in the afternoon.	0	31.4	7.1	69.0	W/NW
24-Jul-22	Sun	Clear tonight. Light to moderate southwesterly winds.	0	32.4	6.2	68.0	W/SW
25-Jul-22	Mon	Light to moderate southwesterly winds.	0	32.3	6.2	70.5	S/SW
26-Jul-22	Tue	Very hot and sunny during the day	0	31.7	6.2	74.2	E/SE
27-Jul-22	Wed	Fine and very hot.	0	31.4	6	70.0	W/SW
28-Jul-22	Thu	Light to moderate southwesterly winds.	0	31.6	3.7	71.0	SW
29-Jul-22	Fri	Mainly fine apart from isolated showers and squally thunderstorms.	0	32	8.7	69.5	W/SW
30-Jul-22	Sat	Sunny and very hot in the afternoon.	2.4	28.2	11.2	75.5	S/SE
31-Jul-22	Sun	Very hot and sunny during the day	0	30.9	5	71.7	W/SW



### **Appendix** L

**Waste Flow Table** 

#### Monthly Summary Waste Flow Table for 2022 (year)

Name of Person completing the record: K.M. Lui (EO)

Project: Liangtang / Heung Yuen Wai Boundary Control Point Site Formation and Infrastructure Works – Contract 6

110,000.21	anguang, muang				anon and mnasu	ucture works				Contract No C V/	
		Actual Quantit	ies of Inert C&	D Materials Ge	nerated Monthly		Ac	tual Quantities	of C&D Waste	s Generated Mo	nthly
Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000m <sup>3</sup> )	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	$(in '000 m^3)$
Jan	0.006	0	0	0	0.006	0	0	0	0	0	0.004
Feb	0.392	0	0	0	0.392	0	0	0	0	0	0.001
Mar	0.293	0	0	0	0.293	0	0	0	0	0	0.001
Apr	0.000	0	0	0	0	0	0	0	0	0	0.006
May	0.000	0	0	0	0	0	0	0	0	0	0.001
Jun	0.045	0	0	0	0.045	0	0	0	0	0	0.000
Sub-total	0.736	0.000	0.000	0.000	0.736	0.000	0.000	0.000	0.000	0.000	0.013
Jul	0.000	0	0	0	0	0	0	0	0	0	0.007
Aug											
Sep											
Oct											
Nov											
Dec											
Total	0.736	0.000	0.000	0.000	0.736	0.000	0.000	0.000	0.000	0.000	0.020

Contract No.: CV/2013/08

Notes:

- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (2) Plastics refer to plastic bottles/containers, plastic sheets/ foam from packaging materials.
- (3) Broken concrete for recycling into aggregates.



### Appendix M

## **Implementation Schedule for Environmental Mitigation Measures**



#### **Environmental Mitigation Implementation Schedule**

EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
Air Quality	Impact (Co		1	т	T	T	1	Г
3.6.1.1	2.1	General Dust Control Measures  The following dust suppression measures should be implemented:  ■ Frequent water spraying for active construction areas (4 times per day for active areas in Po Kak Tsai and 8 times per day for all other active areas), including areas with heavy construction and slope cutting activities  ■ 80% of stockpile areas should be covered by impervious sheets  ■ Speed of trucks within the site should be controlled to about 10 km/hr  ■ All haul roads within the site should be paved to avoid dust emission due to vehicular movement	To minimize adverse dust emission generated from various construction activities of the works sites	Contractor	Construction Works Sites	During Construction	EIA Recommendation and Air Pollution Control (Construction Dust) Regulation	Implemented. (*almost all the work area was hard paved)
3.6.1.2	2.1	Best Practice for Dust Control The relevant best practices for dust control as stipulated in the Air Pollution Control (Construction Dust) Regulation should be adopted to further reduce the construction dust impacts of the Project. These best practices include: Good site management.  The Contractor should maintain high standard of housekeeping to prevent emission of fugitive dust.  Loading, unloading, handling and storage of raw materials, wastes or by-products should be carried out in a manner so as to minimize the release of visible dust emission.  Any piles of materials accumulated on or around the work areas should be cleaned up regularly.  Cleaning, repair and maintenance of all plant facilities within the work areas should be carried out in a manner minimizing generation of fugitive dust emissions.  The material should be handled properly to prevent fugitive dust emission before cleaning.  Disturbed Parts of the Roads  Each and every main temporary access should be paved	To minimize adverse dust emission generated from various construction activities of the works sites	Contractor	Construction Works Sites	During Construction	EIA Recommendation and Air Pollution Control (Construction Dust) Regulation	Implemented. (*almost all the work area was hard paved)



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		with oncrete, bituminous hardcore materials or metal plates and kept clear of dusty materials; or  Unpaved parts of the road should be sprayed with water or a dust suppression chemical so as to keep the entire road surface wet.  Exposed Earth  Exposed earth should be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six months after the last construction activity on the site or part of the site where the exposed earth lies.  Loading, Unloading or Transfer of Dusty Materials  All dusty materials should be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.  Debris Handling  Any debris should be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides.  Before debris is dumped into a chute, water should be sprayed so that it remains wet when it is dumped.  Transport of Dusty Materials  Vehicle used for transporting dusty materials/spoils should be covered with tarpaulin or similar material. The cover should extend over the edges of the sides and tailboards.  Wheel washing  Vehicle wheel washing facilities should be provided at each construction site exit. Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.  Immediately before leaving the construction site, every vehicle should be washed to remove any dusty materials from its body and wheels.  Immediately before leaving the construction site, is carrying a load of dusty materials, the load should be covered entirely by clean						



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
Air Quality	/ Impact (Or	impervious sheeting to ensure that the dusty materials do not leak from the vehicle.  Site hoarding  Where a site boundary adjoins a road, street, service lane or other area accessible to the public, hoarding of not less than 2.4m high from ground level should be provided along the entire length of that portion of the site boundary except for a site entrance or exit.  Blasting  The areas within 30m from the blasting area should be wetted with water prior to blasting						
3.5.2.2	2.2	The following odour containment and control measures will be provided for the proposed sewage treatment work at the BCP site:  The treatment work will be totally enclosed. Negative pressure ventilation will be provided within the enclosure to avoid any fugitive odorous emission from the treatment work.  Further odour containment will be achieved by covering or confining the sewage channels, sewage tanks, and equipment with potential odour emission.  Proper mixing will be provided at the equalization and sludge holding tanks to prevent sewage septicity.  Chemical or biological deodorisation facilities with a minimum odour removal efficiency of 90% will be provided to treat potential odorous emissions from the treatment plant including sewage channels / tanks, filter press and screening facilities so as to minimize any potential odour impact to the nearby ASRs.	To minimize potential odour impact from operation of the proposed sewage treatment work at BC.	DSD	ВСР	Operation Phase	EIA recommendation	Implemented.
Noise Impa	ct (Construc	1 7	1	L	L	1	1	1
4.4.1.4	3.1	Adoption of Quieter PME  Use of the recommended quieter PME such as those given in the BS5228: Part 1:2009 and presented in Table 4.14, which can be found in Hong Kong.	To minimize the construction airborne noise impact	Contractor	Construction Work Sites	During Construction	EIA recommendation, EIAO and Noise Control Ordinance (NCO)	Implemented. (no noisy was observed in the reporting period)



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
4.4.1.4	3.1	Use of Movable Noise Barrier  The use of movable barrier for certain PME can further alleviate the construction noise impacts. In general, a 5 dB(A) reduction for movable PME and 10 dB(A) for stationary PME can be achieved depending on the actual design of the movable noise barrier. The Contractor shall be responsible for design of the movable noise barrier with due consideration given to the size of the PME and the requirement for intercepting the line of sight between the NSRs and PME. Barrier material with surface mass in excess of 7 kg/m2 is recommended to achieve the predicted screening effect.	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO	
4.4.1.4	3.1	Use of Noise Enclosure/ Acoustic Shed  The use of noise enclosure or acoustic shed is to cover stationary PME such as air compressor and concrete pump. With the adoption of the noise enclosure, the PME could be completely screened, and noise reduction of 15 dB(A) can be achieved according to the GW-TM.	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO	Implemented. (no noisy was observed in the reporting period)
4.4.1.4	3.1	Use of Noise Insulating Fabric  Noise insulating fabric can be adopted for certain PME (e.g. drill rig, pilling auger etc). The insulating fabric should be lapped such that there are no openings or gaps on the joints.  Technical data from manufacturers state that by using the Fabric, a noise reduction of over 10 dB(A) can be achieved on noise level.	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO	Implemented. (no noisy was observed in the reporting period)



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
4.4.1.4	3.1	<ul> <li>Good Site Practice</li> <li>The good site practices listed below should be followed during each phase of construction:</li> <li>Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme;</li> <li>Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction programme;</li> <li>Mobile plant, if any, should be sited as far from NSRs as possible;</li> <li>Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs; and</li> <li>Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities.</li> </ul>	To minimize the construction airborne noise impact	Contractors	Construction Work Sites	During Construction	EIA recommendation, EIAO and NCO	Implemented. (no noisy was observed in the reporting period)
Noise Impa	act (Operatio							
Table 4.42 and Figure 4.20.1 to 4.20.4	3.2	Road Traffic Noise  Erection of noise barrier/ enclosure along the viaduct section.	To minimize the road traffic noise along the connecting road of BCP	Contractor	Loi Tung and Fanling Highway Interchange	Before Operation	EIAO and NCO	Implemented. (no noisy was observed in the reporting period)
		Fixed Plant Noise						



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
Table 4.46	3.2	Specification of the maximum allowable sound power levels of the proposed fixed plants during daytime and night-time.	To minimize the fixed plant noise impact	Managing Authority of the buildings / Contractor	BCP, Administration Building and all ventilation buildings	Before Operation.	EIA recommendation, EIAO and NCO	Implemented. (no noisy was observed in the reporting period)
4.5.2.4	3.2	The following noise reduction measures shall be considered as far as practicable during operation:  Choose quieter plant such as those which have been effectively silenced;  Include noise levels specification when ordering new plant (including chillier and E/M equipment).  Locate fixed plant/louver away from any NSRs as far as practicable;  Locate fixed plant in walled plant rooms or in specially designed enclosures;  Locate noisy machines in a basement or a completely separate building;  Install direct noise mitigation measures including silencers, acoustic louvers and acoustic enclosure where necessary; and  Develop and implement a regularly scheduled plant maintenance programme so that equipment is properly operated and serviced in order to maintain a controlled level of noise.	To minimize the fixed plant noise impact	Managing Authority of the buildings / Contractor	BCP, Administration Building and all ventilation buildings	Before Operation.	EIAO and NCO	Implemented. (no noisy was observed in the reporting period)
Water Qua	lity Impact	(Construction)					•	
5.6.1.1	4.1	Construction site runoff and drainage  The site practices outlined in ProPECC Note PN 1/94 should be followed as far as practicable in order to minimise surface runoff and the chance of erosion. The following measures are recommended to protect water quality and when properly implemented should be sufficient to adequately control site discharges so as to avoid water quality impacts:  At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal	To control site runoff and drainage; prevent high sediment loading from reaching the nearby watercourses	Contractor	Construction Works Sites	Construction Phase	Practice Note for Professional Persons on Construction Site Drainage (ProPECC Note PN 1/94)	Implemented. (*almost all the work area was hard paved and no wastewater generated.)



		Recommended Mitigation Measures	Objectives of the Recommended	Who to	Location of the	When to	What requirements	Implementation
EIA Ref.	EM&A	Recommended Midgatton Measures	Measures &	implement	measure	implement the	or standards for the	status and
	Ref		Main	the measure?	incusur c	measure?	measure to	remark*
	Kei		Concerns to				achieve?	
			address					
		drainage works and erosion and sedimentation control facilities						
		implemented. Channels (both temporary and permanent drainage pipes						
		and culverts), earth bunds or sand bag barriers should be provided on site						
		to direct stormwater to silt removal facilities. The design of the						
		temporary on-site drainage system should be undertaken by the						
		Contractor prior to the commencement of construction.						
		The dikes or embankments for flood protection should be implemented						
		around the boundaries of earthwork areas. Temporary ditches should be						
		provided to facilitate the runoff discharge into stormwater drainage						
		system through a sediment/silt trap. The sediment/silt traps should be						
		incorporated in the permanent drainage channels to enhance deposition						
		rates, if practical.						
		Sand/silt removal facilities such as sand/silt traps and sediment basins						
		should be provided to remove sand/silt particles from runoff to meet the						
		requirements of the TM standards under the WPCO. The design of						
		efficient silt removal facilities should be based on the guidelines in						
		Appendix A1 of ProPECC Note PN 1/94. Sizes may vary depending						
		upon the flow rate. The detailed design of the sand/silt traps should be						
		undertaken by the Contractor prior to the commencement of						
		construction.						
		All drainage facilities and erosion and sediment control structures should						
		be regularly inspected and maintained to ensure proper and efficient						
		operation at all times and particularly during rainstorms. Deposited silt						
		and grit should be regularly removed, at the onset of and after each						
		rainstorm to ensure that these facilities are functioning properly at all						
		times						
		Measures should be taken to minimize the ingress of site drainage into						
		excavations. If excavation of trenches in wet periods is necessary, they						
		should be dug and backfilled in short sections wherever practicable.						
		Water pumped out from foundation excavations should be discharged						
		into storm drains via silt removal facilities.						
		If surface excavation works cannot be avoided during the wet season						



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		<ul> <li>(April to September), temporarily exposed slope/soil surfaces should be covered by tarpaulin or other means, as far as practicable, and temporary access roads should be protected by crushed stone or gravel, as excavation proceeds. Interception channels should be provided (e.g. along the crest/edge of the excavation) to prevent storm runoff from washing across exposed soil surfaces. Arrangements should always be in place to ensure that adequate surface protection measures can be safely carried out well before the arrival of a rainstorm. Other measures that need to be implemented before, during and after rainstorms are summarized in ProPECC Note PN 1/94.</li> <li>The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows.</li> <li>All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing facility should be provided at construction site exit where practicable. Wash-water should have sand and silt settled out and removed regularly to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains.</li> <li>Open stockpiles of construction materials or construction wastes on-site should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system.</li> <li>Manholes (including newly constructed ones) should be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and stormwater runoff being directed into foul sewers.</li> <li>Precautions should be taken at any time of the year when rainstorm</li></ul>						



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		summarized in Appendix A2 of ProPECC Note PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes.  Bentonite slurries used in piling or slurry walling should be reconditioned and reused wherever practicable. Temporary enclosed storage locations should be provided on-site for any unused bentonite that needs to be transported away after all the related construction activities are completed. The requirements in ProPECC Note PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.						
5.6.1.1	4.1	<ul> <li>Good site practices for works within water gathering grounds</li> <li>The following conditions should be complied, if there is any works to be carried out within the water gathering grounds:</li> <li>Adequate measures should be implemented to ensure no pollution or siltation occurs to the catchwaters and catchments.</li> <li>No earth, building materials, oil or fuel, soil, toxic materials or any materials that may possibly cause contamination to water gathering grounds are allowed to be stockpiled on site.</li> <li>All surplus spoil should be removed from water gathering grounds as soon as possible.</li> <li>Temporary drains with silt traps should be constructed at the site boundary before the commencement of any earthworks.</li> <li>Regular cleaning of silt traps should be carried out to ensure proper operation at all time.</li> <li>All excavated or filled surfaces which have the risk of erosion should always be protected form erosion.</li> </ul>	To minimize water quality impacts to the water gathering grounds	Contractor	Construction Works Sites within the water gathering	Construction Phase	ProPECC Note PN 1/94	Implemented. (*almost all the work area was hard paved and no wastewater generated.)



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		• Facilities for washing the wheels of vehicles before leaving the site						
		should be provide						
		Any construction plant which causes pollution to catchwaters or						
		catchments due to the leakage of oil or fuel should be removed off site						
		immediately.						
		No maintenance activities which may generate chemical wastes should						
		be undertaken in the water gathering grounds. Vehicle maintenance						
		should be confined to designated paved areas only and any spillages						
		should be cleared up immediately using absorbents and waste oils should						
		be collected in designated tanks prior to disposal off site. All storm water						
		run-off from these areas should be discharged via oil/petrol separators						
		and sand/silt removal traps.						
		• Any soil contaminated with fuel leaked from plant should be removed						
		off site and the voids arising from removal of contaminated soil should						
		be replaced by suitable material approved by the Director of Water						
		Supplies.						
		Provision of temporary toilet facilities and use of chemicals or						
		insecticide of any kind are subject to the approval of the Director of						
		Water Supplies.						
		Drainage plans should be submitted for approval by the Director of						
		Water Supplies.						



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		<ul> <li>An unimpeded access through the waterworks access road should always be maintained.</li> <li>Earthworks near catchwaters or streamcourses should only be carried out in dry season between October and March,</li> <li>Advance notice must be given before the commencement of works on site quoting WSD's approval letter reference.</li> </ul>						
5.6.1.2	4.1	Good site practices of general construction activities  Construction solid waste, debris and refuse generated on-site should be collected, handled and disposed of properly to avoid entering any nearby stormwater drain. Stockpiles of cement and other construction materials should be kept covered when not being used.  Oils and fuels should only be stored in designated areas which have pollution prevention facilities. To prevent spillage of fuels and solvents to any nearby stormwater drain, all fuel tanks and storage areas should be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank. The bund should be drained of rainwater after a rain event.	To minimize water quality impacts	Contractor	All construction site	Construction phase	EIA recommendation	Implemented. (*almost all the work area was hard paved and no wastewater generated.)
5.6.1.3	4.1	Sewage effluent from construction workforce  Temporary sanitary facilities, such as portable chemical toilets, should be employed on-site where necessary to handle sewage from the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	To minimize water quality impacts	Contractor	All construction works sites with on-site sanitary facilities	Construction phase	EIA Recommendation and Water Pollution Control Ordinance (WPCO)	Implemented. (*almost all the work area was hard paved and no wastewater generated.)
5.6.1.4	4.1	Hydrogeological Impact Grout injection works would be conducted before blasting, for sealing a limited area around the tunnel with a grout of a suitable strength for controlling the potential groundwater inflows. The pre-injection grouting method would be supplemented by post-injection grouting	To minimize water quality impacts	Contractor	Construction works sites of the drill and blast tunnel	Construction phase	EIA Recommendation and WPCO	Implemented. (*almost all the work area was hard paved and no wastewater



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		where necessary to further enhance the groundwater inflow control. On-site treatment for the groundwater ingress pumped out would be required to remove any contamination by grouting materials before discharge off-site.						generated.)
Water Qua	lity Impact	(Operation)						
		No mitigation measure is required.						
Sewage and	d Sewerage 7	Treatment Impact (Construction)  The sewage generated by the on-site workforce should be collected in chemical toilets and disposed of off-site by a licensed waste collector.	To minimize water quality	Contractor	All construction works sites with	Construction phase	EIA recommendation	Implemented. (*almost all the
		tones and disposed of our site by a needsed waste conector.	impacts		on-site sanitary facilities	phase	and WPCO	work area was hard paved and no wastewater generated.)
Sewage and	d Sewerage T	Freatment Impact (Operation)	1			•	1	
6.6.3	5	Sewage generated by the BCP and Chuk Yuen Village Resite will be collected and treated by the proposed on-site sewage treatment facility using Membrane Bioreactor treatment with a portion of the treated wastewater reused for irrigation and flushing within the BCP.	To minimize water quality impacts	DSD	ВСР	Operation phase	EIA recommendation and WPCO	Implemented.
6.5.3	5	Sewage generated from the Administration Building will be discharged to the existing local sewerage system.	To minimize water quality impacts	DSD	Administration Building	Operation phase	EIA recommendation and WPCO	Implemented.
Waste Mar	nagement Im	plication (Construction)						
7.6.1.1	6	Good Site Practices  Adverse impacts related to waste management such as potential hazard, air, odour, noise, wastewater discharge and public transport as mentioned in section 3.4.7.2 (ii)(c) of the Study Brief are not expected to arise, provided that good site practices are strictly followed. Recommendations for good site practices during the construction activities include:	To minimize adverse environmental impact	Contractor	Construction works sites (general)	Construction phase	EIA recommendation; Waste Disposal Ordinance; Waste Disposal (Chemical Wastes) (General) Regulation; and ETWB TC(W) No.	Implemented. (no C&D waste generated within site area and only a few general refuse was disposed in the



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		responsible for good site practices, arrangements for collection and					Environmental	
		effective disposal to an appropriate facility, of all wastes generated at the					Management on	
		site					Construction Site	
		<ul> <li>Training of site personnel in proper waste management and chemical</li> </ul>						
		handling procedures						
		<ul> <li>Provision of sufficient waste disposal points and regular collection of</li> </ul>						
		waste						
		<ul> <li>Dust suppression measures as required under the Air Pollution Control</li> </ul>						
		(Construction Dust) Regulation should be followed as far as practicable.						
		Appropriate measures to minimise windblown litter and dust/odour						
		during transportation of waste by covering trucks or in enclosed						
		containers						
		• General refuse shall be removed away immediately for disposal. As such						
		odour is not anticipated to be an issue to distant sensitive receivers						
		• Provision of wheel washing facilities before the trucks leaving the works						
		area so as to minimise dust introduction from public road						
		<ul> <li>Covers and water spraying system should be provided for the stockpiled</li> </ul>						
		C&D material to prevent dust impact or being washed away						
		<ul> <li>Designate different locations for storage of C&amp;D material to enhance</li> </ul>						
		reuse						
		<ul> <li>Well planned programme for transportation of C&amp;D material to lessen</li> </ul>						
		the off-site traffic impact. Well planned delivery programme for offsite						
		disposal and imported filling material such that adverse noise impact						
		from transporting of C&D material is not anticipated						
		• Site practices outlined in ProPECC PN 1/94 Construction Site						
		Drainage should be adopted as far as practicable, such as cleaning and						
		maintenance of drainage systems regularly						
		Provision of cover for the stockpile material, sand bag or earth bund as						
		barrier to prevent material from washing away and entering the drains						



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
7.6.1.2	6	Waste Reduction Measures  Good management and control can prevent the generation of a significant amount of waste. Waste reduction is best achieved at the planning and design stage, as well as by ensuring the implementation of good site practices. Recommendations to achieve waste reduction include:  Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal  Encourage collection of aluminium cans by providing separate labelled bins to enable this waste to be segregated from other general refuse generated by the work force  Proper storage and site practices to minimise the potential for damage or contamination of construction materials  Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste  In addition to the above measures, specific mitigation measures are recommended below for the identified waste arising to minimise environmental impacts during handling, transportation and disposal of these wastes.	To reduce the quantity of wastes	Contractor	Construction works sites (General)	Construction phase	EIA recommendation and Waste Disposal Ordinance	Implemented. (no C&D waste generated within site area and only a few general refuse was disposed in the reporting period)
7.6.1.3	6	C&D Materials  In order to minimise impacts resulting from collection and transportation of C&D material for off-site disposal, the excavated materials should be reused on-site as backfilling material as far as practicable. The surplus rock and other inert C&D material would be disposed of at the Government's Public Fill Reception Facilities (PFRFs) at Tuen Mun Area 38 for beneficial use by other projects in the HKSAR as the last resort. C&D waste generated from general site clearance and tree felling works would require disposal to the designated landfill site. Other mitigation requirements are listed below:  ■ A Waste Management Plan should be prepared and implemented in accordance with ETWB TC(W) No. 19/2005 Environmental	To minimize impacts resulting from C&D material	Contractor	Construction works sites (General)	Construction phase	EIA recommendation; Waste Disposal Ordinance; and ETWB TCW No. 31/2004	Implemented. (no C&D waste generated within site area and only a few general refuse was disposed in the reporting period)



EIA Ref.	EM&A Ref	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve?	Implementation status and remark*
		<ul> <li>Management on Construction Site; and</li> <li>In order to monitor the disposal of C&amp;D material and solid wastes at public filling facilities and landfills, and to control fly-tipping, a trip-ticket system (e.g. ETWB TCW No. 31/2004) should be included.</li> </ul>						
7.6.1.4	6	General refuse General refuse should be stored in enclosed bins or compaction units separated from other C&D material. A reputable waste collector is to be employed by the Contractor to remove general refuse from the site separately. Preferably an enclosed and covered area should be provided to reduce the occurrence of 'wind blown' litter.	To minimize impacts resulting from collection and transportation of general refuse for off-site disposal	Contractor	Construction works sites (General)	Construction phase	Waste Disposal Ordinance and Public Health and Municipal Services Ordinance - Public Cleansing and Prevention of Nuisances Regulation	Implemented.
7.6.1.5	6	Chemical waste  If chemical wastes are produced at the construction site, the Contractor will be required to register with the EPD as a chemical waste producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical	To minimize impacts resulting from collection and transportation of chemical waste for off-site disposal	Contractor	Construction works sites (General)	Construction phase	Waste Disposal (Chemical Waste) (General) Regulation and Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes	Implemented. (no chemical waste was generated.)



### Appendix N

# **Implementation Status of Mitigation Measures for Operation Phase**



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
	ty Impact (Operation)	T	1		T	T	
EP C3.11/ EIA Section 3.5.2.2	The sewage treatment plant installed for the Project shall be installed at the location shown in Figure 3 of the EP  The plant shall be designed with the following odour containment and control measures:	To minimize potential odour impact from operation of the proposed sewage treatment work at BCP	DSD	Sewage Treatment Plant (STP) at BCP	Operation Phase	Fully implemented	STP was implemented at BCP and it was handover to DSD on 29 July 2019 for operation.
	Negative Pressure Ventilation     The treatment plant shall be totally enclosed with negative pressure ventilation to avoid odorous emission from the treatment works. The tanks will be connected to deodorisation facilities designed for a minimum removal of 90% directly to eliminate odour					Fully implemented	The STP was enclosed with negative pressure ventilation and the tanks are connected to deodorisation facilities.
	problem.  2. Total Containment of Sewage Channels  (a) air-tight cover shall be installed to sewage channels, sewage tanks, and equipment with potential odour emission and the trapped gases shall be collected by air handling equipment for containing and directing odorous gases to deodorisation facilities.					Fully implemented	The underground sewage tank, sewage channel and potential odour emission with air tight cover and were connected to deodorisation facilities.



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
	(b) Gravity sewer, equalization and sludge holding tanks shall be designed with suitable sewer distance and retention time to prevent sewage septicity.						
	3. Proper mixing will be provided at the equalization and sludge holding tanks to prevent sewage septicity.					Fully implemented	-
	4. <u>Deodorisation</u> (a) Deodorisation facilities at the sewage treatment plant shall be designed with a minimum odour removal efficiency of 90%.					Fully implemented	The deodorisation facilities was monitored by control room to ensure odour removal efficiency of 90%.
EP C3.12	The air intake point of Boundary Control Point Building shall be located at least 150m from the sewage treatment plant.	To minimize potential odour impact from operation of the proposed sewage treatment work at BCP	DSD	STP at BCP	During detailed design/ before operation Phase	Fully implemented	
Noise Imp	pact (Operation)						
EP C3.5 / EIA Table 4.42 and Figure	Erection of noise barrier/ enclosure along the viaduct section.  - To mitigate the traffic noise impact arising from the operation of the	To minimize the road traffic noise along the connecting road of BCP	Contractor	Loi Tung and Fanling Highway Interchange	Before Operation	Fully implemented	Noise barriers were installed in accordance with the Noise Mitigation Plan.



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
4.20.1 to 4.20.4	Project, the noise mitigation measures shall be implemented in accordance with Fig 4, 5, 6 and 7 attached to the EP, or otherwise approved by the Director subject to the submission of a Noise Mitigation Plan by the Permit Holder to cater for the final layout and design of the Project.						
	Fixed Plant Noise					1	
EIA Table 4.46	Specification of the maximum allowable sound power levels of the proposed fixed plants during daytime and night-time.	To minimize the fixed plant noise impact	Managing Authority of the buildings / Contractor	BCP, Administration Building and all ventilation buildings	Before Operation	Fully implemented	-
EIA Section 4.6.2	Commissioning test should be conducted for all major fixed noise sources to ensure compliance of the operational for all major fixed noise sources before operation.	To minimize the fixed plant noise impact	Managing Authority of the buildings / Contractor	BCP, Administration Building and all ventilation buildings	Before Operation	Fully implemented	-
EIA Section 4.5.2.4	The following noise reduction measures shall be considered as far as practicable during operation:  Choose quieter plant such as those which have been effectively silenced;  Include noise levels specification when ordering new plant (including chillier and E/M	To minimize the fixed plant noise impact	Managing Authority of the buildings / Contractor	BCP, Administration Building and all ventilation buildings	Before Operation	Fully implemented	-



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
	equipment);						
	<ul> <li>Locate fixed plant/louver away from any NSRs as far as practicable;</li> <li>Locate fixed plant in walled plant rooms or in specially designed enclosures;</li> <li>Locate noisy machines in a basement or a completely separate building;</li> <li>Install direct noise mitigation measures including silencers, acoustic louvers and acoustic enclosure where necessary; and</li> <li>Develop and implement a regularly scheduled plant maintenance programme so that</li> </ul>						
	equipment is properly operated and serviced in order to maintain a controlled level of noise.						
Sewage at	nd Sewerage Treatment Impact (Operati	on)	1	1	L	1	1
EIA Section 5.6.2.1	The implementation of proper channel/pipeline/cross road pipes to maintain the overland flow path, and that drainage channel would be provided to convey the storm drain and	To minimize water quality impacts	DSD	For connecting road	Operation phase	Fully implemented	The permanent drainage works have been implemented in accordance with the recommendations in the



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
	discharge at downstream of River Indus.						Drainage Impact Assessment (DIA) for the project
EIA Section 6.6.3	Sewage generated by the BCP and Chuk Yuen Village Resite will be collected and treated by the proposed on-site sewage treatment facility using Membrane Bioreactor treatment with a portion of the treated wastewater reused for irrigation and flushing within the BCP.	To minimize water quality impacts	DSD	ВСР	Operation phase	Fully implemented	-
EIA Section 6.5.3	Sewage generated from the Administration Building will be discharged to the existing local sewerage system.	To minimize water quality impacts	DSD	Administration Building	Operation phase	Fully implemented	-
Waste Ma	anagement (Operation)				1	1	
7.6.2.1	General refuse General refuse should be collected on daily basis and delivered to the refuse collection point accordingly. A reputable waste collector should be employed to remove general refuse regularly to avoid odour nuisance or pest and vermin problem. Recycling containers are recommended to be provided to encourage recycling of aluminium cans and waste paper.	To minimize impacts resulting from collection and transportation of general refuse for off-site disposal	Managing Authority of the BCP	BCP and its Associated facilities	Operation phase	Fully implemented	



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
7.6.2.2	<ul> <li>Register with the EPD as a chemical waste producer should be made and guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes should be followed.</li> <li>Good quality containers compatible with the chemical wastes should be used, and incompatible chemicals should be stored separately. Appropriate labels should be securely attached on each chemical waste container indicating the corresponding chemical characteristics of the chemical waste, such as explosive, flammable, oxidizing, irritant, toxic, harmful, corrosive, etc. Licensed collector should be deployed to transport and dispose of the chemical wastes, to the licensed Chemical Waste Treatment Centre, or licensed facilities, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.</li> </ul>	To minimize impacts resulting from collection and transportation of general refuse for off-site disposal	Managing Authority of the BCP	BCP and its Associated facilities	Operation phase	Fully implemented	
Ecological EIA	Impact   Mitigation to Noise Disturbance to	To minimize the	Contractors	ВСР,	Before Operation	Fully	-



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main	Who to implement the	Location of the measures	When to implement the measures?	Implementation Status	Remarks
		Concern to Address	measures?				
Section 9.8	Wildlife The following noise reduction measures shall be considered as far as practicable during operation:  Choose quieter plant such as those which have been effectively silenced;  Include noise levels specification when ordering new plant (including chillier and E/M equipment);  Locate fixed plant in walled plant rooms or in specially designed enclosures;  Locate noisy machines in a basement or a completely separate building;  Install direct noise mitigation measures including silencers, acoustic louvers and acoustic enclosure where necessary; and  Develop and implement a regularly scheduled plant maintenance;  programme so that equipment is properly operated and serviced in	impact to wildlife	measures?	Administration Building and all ventilation buildings		implemented	
	order to maintain a controlled level of noise.						
EIA Section	Mitigation to Anthropogenic Disturbance	To screen the Proposed structures	Contractors	In proximity to administration	Operation phase	Fully implemented	Refer to OM4 below



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
9.8	Buffer planting shall be provided for screening the proposed structures and associated facilities.	and associated facilities.		Building and all ventilation buildings and associated facilities.			
EIA Section 9.8	<ul> <li>Mitigation to Habitat Fragmentation</li> <li>Landscape fragmentation should be kept to a minimum and key wildlife routes preserved as far as possible (i.e. OM1 of EM&amp;A Manual Chapter 10).</li> <li>Provision of landscape plantings (i.e. OM3-7 of EM&amp;A Manual Chapter 10)</li> </ul>	To minimize the obstruction on wildlife movement	Contractors	All viaduct sections	Operation phase	Fully implemented	Refer to OM1 below.  Refer to OM3 to 7 below.
EP C3.7	To reduce collisions from birds, the design of noise barriers shall avoid/minimize the use of transparent / reflective materials or adopt bird-friendly design on such surfaces.	To avoid bird mortality due to collision with noise barrier	Contractors	Locations with erection of noise barrier	During detailed design and construction phases	Fully implemented	Steel works of noise barrier was painted in different tone of mat finished green and avoid use of transparent / reflective materials.
EP C4.1	The ecological mitigation measures stated in the Woodland Compensation Plan and Habitat Creation and Management Plan are properly implemented, maintained and monitored during the entire period of the life of the Project.	To mitigate the loss woodland and Wetland	Contractors	woodland compensation area and wetland compensation area	Operation phase	Fully implemented	Refer Table 1-2
Landscap	e, Visual and Glare Impact						
EP C3.8 &	(OM1) Detailed Design Considerations	To reduce architectural footprint	Detailed designer/	BCP, Administration	During Detailed Design &	Fully implemented	The detail landscape design of the project is



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measures	When to implement the measures?	Implementation Status	Remarks
EIA 11.6.3 & Table 11.16 (OM1)	Detailed design of development components should aim to reduce landscape footprint and visibility of structures. The area allowed for any development components should be reduced to a practical minimum.	on the land and minimize visibility of structures.	Consultants	Building and all ventilation buildings	Construction/ Operation Phase		divided into 3 packages as described in the Landscape Plan.
EP C3.8 & EIA 11.6.3 & Table 11.16 (OM2)	(OM2) Aesthetically Pleasing Design The form, textures, finishes and colours of the proposed development components should be compatible with the existing surroundings. Light earthy tone colours such as shades of green, shades of grey, shades of brown and off-white may be utilised where technically feasible to reduce the visibility of the development components, including all roadwork, buildings and noise barriers etc. To further improve visual amenity, natural building materials such as stone and timber, should be preferably adopted for architectural features, where technically feasible.	To reduce visibility of structures and increase their compatibility with the surrounding	Detailed designer/ Consultants	Noise Barriers	During Detailed Design & Construction/ Operation Phase	Fully implemented	The steel works of noise barrier are painted in different tone of mat finished green to blend in with the surrounding.
EP C3.8 & EIA 11.6.3 & Table 11.16 (OM3)	(OM3) Compensatory Planting All compensatory planting of trees is to be carried out in accordance with ETWB TCW No. 03/2006.	To compensate for loss of trees and some shrubs due to the Project.	Contractors	Woodland compensation area, in proximity to administration Building and all ventilation	During Construction/ Operation Phase	Fully implemented	The programme of woodland compensation has been commenced in early 2016 according to the Woodland.  Compensation Plan.



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main	Who to implement the	Location of the measures	When to implement the measures?	Implementation Status	Remarks
		Concern to Address	measures?				
				buildings and associated facilities and Viaduct Structure			Other compensatory planting shall refer to OM4 and OM10.
EP C3.8 & EIA 11.6.3 & Table 11.16 (OM4)	(OM4) Buffer Tree Planting  Tree planting shall be provided to screen the proposed structures and associated facilities. In addition, the compensatory shrub and ground cover planting detailed in OM4 will provide screening and improve compatibility with the surrounding environment.	To screen the proposed structures and associated facilities including roads.	Contractors	In proximity to administration Building and all ventilation buildings and associated facilities.	During Construction/ Operation Phase	Fully implemented	New planting has been provided for Buffet Tree Planting.
EP C3.8 & EIA 11.6.3 & Table 11.16 (OM5)	(OM5) Aesthetic Improvement Planting - Viaduct Structure Planters will be provided for trailer planting to soften the hard, straight edges of the viaduct. Where space allows for planters, climbers are proposed to cover vertical, hard surfaces of the piers.	To soften the hard edges on the viaduct and maximize greening opportunity.	Contractors	Viaduct Structure.	During Construction/ Operation Phase	Fully implemented	Shrub plantings are provided on the viaduct planters.
EP C3.8 & EIA 11.6.3 & Table 11.16 (OM6)	(OM6) Aesthetic Improvement Planting – under Viaduct Shade tolerant plant will be planted, where light is insufficient, to improve value of areas under viaducts.	To soften the hard edges on the viaduct and maximize greening opportunity.	Contractors	Viaduct Structure.	During Construction/ Operation Phase	Fully implemented	Amenity palm and shrub are planted under the viaduct structures connecting the existing Fanling Highway.
EP C3.8 &	(OM7) Landscaped Slope Where existing hillside slopes are	To prevent soil erosion and reduce	Contractors	Newly formed slope	During Construction/ Operation Phase	Fully implemented	Varies format of landscape treatment are



EP/ EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main	Who to implement the	Location of the measures	When to implement the measures?	Implementation Status	Remarks
		Concern to Address	measures?				
EIA	anticipated to be modified (eg cut slope	visible impact of					applied on all newly
11.6.3 &	at the portals of the tunnel sections and	man-made slopes.					formed slope features,
Table	embankments along the alignment) the						to suit the site
11.16	final slope surface will be landscaped						conditions including
(OM7)	by hydroseeding, tree or shrub planting where slope gradient allows.						slope gradient and soil depth.
EP C3.8	(OM8) Green Roof	To reduce exposure	Contractors	BCP,	During Construction/	Fully	Suitable shrubs and
&	Green roofing should be established on	to untreated concrete		Administration	Operation Phase	implemented	ground covers are
EIA	proposed buildings to reduce exposure	surfaces, reduce		Building and all			planted in building
11.6.3 &	to untreated concrete surfaces and	visual impact to		ventilation			roofs of new buildings.
Table	mitigate visual impact to VSRs at high	VSRs at high levels		buildings			
11.16	levels.	and maximize					
(OM8)		greening opportunity.					
EP C3.8	(OM9) Vertical Greening	To reduce visible	Contractors	BCP,	During Construction/	Fully	Planters are provided
&	Vertical planting should be established	impact of proposed		Administration	Operation Phase	implemented	by the building edges in
EIA	to soften the hard, vertical surfaces of	new structures and		Building and all			building roofs of new
11.6.3 &	the proposed development components.	facilities and		ventilation			development structures.
Table	These components will include walls of	maximize greening		buildings			
11.16	administration and ventilation	opportunity.					
(OM9)	buildings, retaining walls and road						
	abutments.						
EP C3.8	(OM10) Roadside Amenity Planting	To soften edges of	Contractors	Roadside of the	During Construction/	Fully	New plantings are
&	Roadside amenity planting should be	the proposed engineer		project	Operation Phase	implemented	provided for Roadside
EIA	provided, to enhance the landscape and	structures and					Amenity Planting
11.6.3 &	visual quality of the existing and	associated facilities					
Table	proposed transport routes and car parks.	and enhance the					
11.16		landscape and visual					
(OM10)		quality of the existing					
		and proposed road.					
EP C3.8	(OM11) Reinstatement	Particularly aimed at	Contractors	Existing	During Construction/	Fully	Reinstatement works



EP/ EIA	<b>Recommended Mitigation Measures</b>	Objectives of the	Who to	Location of the	When to implement	Implementation	Remarks
Ref.		Recommended	implement	measures	the measures?	Status	
		Measures & Main	the				
		Concern to Address	measures?				
&	Certain areas unavoidably disturbed by	temporarily disturbed		engineering	Operation Phase	implemented	are provided to the
EIA	the Project will be reprovisioned.	areas, to reduce long		channel Ma Wat			disturbed existing
11.6.3 &		term impact on		River.			engineering channel Ma
Table		landscape.					Wat River.
11.16							
(OM11)							
EP C3.8,	(OM12) Light Control	To minimize glare	Contractors	Lit areas around	During Operation	Fully	Light controls are
EP C3.9	Street and night time lighting glare will	impact to adjacent		BCP,	Phase	implemented	provided at new
&	be controlled to minimize glare impact	VSRs.		Administration			buildings.
EIA	to adjacent VSRs during the operation			Building and all			
11.6.3 &	stage.			ventilation			
Table				buildings and			
11.16				along roads.			
(OM12)							
EP C3.8	(OM13) Reprovisioned LCSD	To compensate for	Contractors	Near existing	During Construction/	Fully	1256.4m <sup>2</sup> of site area at
&	Garden	loss of Open Space		Wo Keng Shan	Operation Phase	implemented	the north of Sha Tau
EIA	The Open Space of Wo Keng Shan	due to the Project.		public garden			Kok Interchange will be
11.6.3 &	public garden falls within the Project						converted to a
Table	Site and will be reprovisioned to						re-provision LCSD Wo
11.16	reprovide the amenities of the garden						Keng Shan Garden is
(OM13)	on a one to one basis.						implemented.



**Appendix O** 

**Complaint Log** 



**Environmental Complaint Log for CE 45/2008** 

Log		Complaint	Reference no.	Complaint	Investigation	Status
ref. 1*	complaint	route		nature	fining	2 11112
2*						
3	22 January 2014	CEDD	CE 45/2008 - 03	Construction Dust	Non-project related	Interim IR was submitted to EPD on 13 February 2014 and included in EM&A Report – Jan 2014
4	16 May 2014	Public	CE 45/2008 - 04	Muddy water discharge	Non-project related	Interim IR was submitted to EPD on 11 June 2014 and included in EM&A Report – May 2014
4a	16 May 2014	EPD	CE 45/2008 - 04a	Muddy water discharge	Project related	Interim IR was submitted to EPD on 11 June 2014 and included in EM&A Report – May 2014
5	27 June 2014	Public	CE 45/2008 - 05	General / Water	Non-project related	Interim IR was submitted to EPD on 14 July 2014 and included in EM&A Report – June 2014
6	27 June 2014	DSD	CE 45/2008 - 06	Muddy water discharge	Project related	Interim IR was submitted to EPD on 25 July 2014 and included in EM&A Report – June 2014
7	17 July 2014	Public	CE 45/2008 - 07	Dust	Project related	Interim IR was submitted to EPD on 14 August 2014 and included in EM&A Report – August 2014
8	3 November 2014	Public	CE 45/2008 - 08	Dust	Project related	Interim IR was submitted to EPD on 26 November 2014 and included in EM&A Report – November 2014
9	21 November 2014	EPD	CE 45/2008 - 09	Water Quality	Non-project related	Interim IR was submitted to EPD on 9 December 2014 and included in EM&A Report – November 2014
10	11 November 2014	RE	CE 45/2008 - 10	Noise and Dust	Non-project related	Interim IR was submitted to EPD on 10 December 2014 and included in EM&A Report – November 2014



	1	-		1	ı	T
11	16 December 2014	RE	CE 45/2008 - 11	Noise	Project related	Interim IR was submitted to EPD on 23 December 2014 and included in EM&A Report – December 2014
12	16 December 2014	EPD	CE 45/2008 - 12	Dust	Non-project related	Interim IR was submitted to EPD on 24 December 2014 and included in EM&A Report – December 2014
13	23 December 2014	EPD	CE 45/2008 - 13	Soil/ muddy water	Non-project related	Interim IR was submitted to EPD on 8 January 2015 and included in EM&A Report – December 2014
14	22 December 2014	EPD	CE 45/2008 - 14	Dust	Non-project related	Interim IR was submitted to EPD on 8 January 2015 and included in EM&A Report – December 2014
15	12 January 2015	1823	CE 45/2008 - 15	Dust	Non-project related	Interim IR was submitted to EPD on 23 January 2015 and included in EM&A Report – January 2015
16	27 January 2015	1823	CE 45/2008 - 16	Dust	Non-project related	Interim IR was submitted to EPD on 4 February 2015 and included in EM&A Report – January 2015
17	28 January 2015	EPD	CE 45/2008 - 17	Soil/ muddy water	Non-project related	Interim IR was submitted to EPD on 6 February 2015 and included in EM&A Report – January 2015
18	22 May 2015	EPD	CE 45/2008 - 18	Soil/ muddy water	Non-project related	Interim IR was submitted to EPD on 18 June 2015 and included in EM&A Report – June 2015
19	9 July 2015	DSD	CE 45/2008 - 19	Soil/ muddy water	Non-project related	Interim IR was submitted to EPD on 29 July 2015 and included in EM&A Report – July 2015
20	9 November 2015	CEDD / EPD / 1823	CE 45/2008 - 20	Soil/ muddy water	Project related	Interim IR was submitted to EPD on 16 November 2015 and included in EM&A Report – November 2015



21	1 December 2015	EPD	CE 45/2008 - 21	Dust	Project related	Interim IR was submitted to EPD on 8 January 2016 and included in EM&A Report – December 2015
22	16 December 2015	EPD	CE 45/2008 - 22	Muddy Water Discharge	Non-project related	Interim IR was submitted to EPD on 22 January 2016 and included in EM&A Report – January 2016
23	4 January 2016	RE	CE 45/2008 - 23	Muddy Water	Project related	Interim IR was submitted to EPD on 12 January 2016 and included in EM&A Report – January 2016
24	14 January 2016	EPD	CE 45/2008 - 24	Soil/ muddy water	Project related	Interim IR was submitted to EPD on 16 February 2016 and included in EM&A Report – January 2016
25	20 January 2016	EPD	CE 45/2008 - 25	Soil/ muddy Water	Project related	Interim IR was submitted to EPD on 4 February 2016 and included in EM&A Report – January 2016
26	18 February 2016	1823	CE 45/2008 - 26	Noise	Non-project related	Interim IR was submitted to EPD on 25 February 2016 and included in EM&A Report – February 2016
27	23 February 2016	CEDD	CE 45/2008 - 27	Soil/ Debris	Non-project related	Interim IR was submitted to EPD on 29 February 2016 and included in EM&A Report – February 2016
28	22 February 2016	EPD	CE 45/2008 - 28	Turbid Water	Project related	Interim IR was submitted to EPD on 10 March 2016 and included in EM&A Report – February 2016
29	8 March 2016	1823	CE 45/2008 - 29	Dust	Non-project related	Interim IR was submitted to EPD on 12 April 2016 and included in EM&A Report – March 2016
30	8 April 2016	CEDD	CE 45/2008 - 30	Wastewater	Non-project related	Interim IR was submitted to EPD on 18 May 2016 and included in EM&A Report – May 2016
31	19 April 2016	HYD / CEDD	CE 45/2008 - 31	Wastewater	Not Valid	Interim IR was submitted to EPD on 31 May 2016 and included in EM&A Report – May 2016



				1	T	
32	21 April 2016	1823 / EPD / CEDD	CE 45/2008 - 32	Dust and muddy water	Non-project related	Interim IR was submitted to EPD on 17 June 2016 and included in EM&A Report – June 2016
33	18 April 2016	CEDD	CE 45/2008 - 33	Wastewater	Non-project related	Interim IR was submitted to EPD on 16 May 2016 and included in EM&A Report – May 2016
34	28 April 2016	CEDD	CE 45/2008 - 34	Muddy Water	Not evidenced	Interim IR was submitted to EPD on 21 May 2016 and included in EM&A Report – June 2016
35	3 May 2016	EPD	CE 45/2008 - 35	Wastewater	Project related	Interim IR was submitted to EPD on 8 June 2016 and included in EM&A Report – May 2016
36	28 May 2016	1823	CE 45/2008 - 36	Dust	Non-project related	Interim IR was submitted to EPD on 13 June 2016 and included in EM&A Report – May 2016
37	28 May 2016	1823	CE 45/2008 - 37	Dust	Non-project related	Interim IR was submitted to EPD on 17 June 2016 and included in EM&A Report – June 2016
38	unknown	CEDD	CE 45/2008 - 38	Noise	Non-project related	Interim IR was submitted to EPD on 5 July 2016 and included in EM&A Report – June 2016
39	31 May 2016	1823	CE 45/2008 - 39	Water	Not evidenced	Interim IR was submitted to EPD on 13 June 2016 and included in EM&A Report – May 2016
40	10 June 2016	1823	CE 45/2008 - 40	Dust	Non-project related	Interim IR was submitted to EPD on 20 June 2016 and included in EM&A Report – June 2016
41	20 June 2016	1823	CE 45/2008 - 41	Noise	Non-project related	Interim IR was submitted to EPD on 28 June 2016 and included in EM&A Report – June 2016
42	20 June 2016	ICC	CE 45/2008 - 42	Muddy water	Non-project related	Interim IR was submitted to EPD on 13 July 2016 and included in EM&A Report – June 2016



	<u></u>			1	ı	1
43	10 July 2016	1823	CE 45/2008 - 43	Dust and Muddy water	Non-project related	Interim IR was submitted to EPD on 21 July 2016 and included in EM&A Report – July 2016
44	13 July 2016	EPD	CE 45/2008 - 44	Muddy water	Non-project related	Interim IR was submitted to EPD on 25 July 2016 and included in EM&A Report – July 2016
45	4 July 2016	ICC	CE 45/2008 - 45	Muddy water	Non-project related	Interim IR was submitted to EPD on 21 July 2016 and included in EM&A Report – July 2016
46	22 July 2016	EPD	CE 45/2008 - 46	Muddy water	Non-project related	Interim IR was submitted to EPD on 16 August 2016 and included in EM&A Report – August 2016
47	24 August 2016	DSD	CE 45/2008 - 47	Water Quality	Non-project related	Interim IR was submitted to EPD on 5 September 2016 and included in EM&A Report – August 2016
48	9 September 2016	1823	CE 45/2008 - 48	wastewater	Project related	Interim IR was submitted to EPD on 23 September 2016 and included in EM&A Report – September 2016
49	20 September 2016	EPD	CE 45/2008 - 49	Muddy water	Non-project related	Interim IR was submitted to EPD on 3 October 2016 and included in EM&A Report – September 2016
50	20 October 2016	EPD	CE 45/2008 - 50	Dust	Project related	Interim IR was submitted to EPD on 7 November 2016 and included in EM&A Report – October 2016
51	28 October 2016	1823	CE 45/2008 - 51	Muddy water	Non-project related	Interim IR was submitted to EPD on 8 November 2016 and included in EM&A Report – October 2016
52	4 November 2016	1823	CE 45/2008 - 52	Muddy water	Non-project related	Interim IR was submitted to EPD on 18 November 2016 and included in EM&A Report – November 2016



r	,			_		
53	31 October 2016 and 2 November 2016	1823	CE 45/2008 - 53	Noise	Non-project related	Interim IR was submitted to EPD on 7 December 2016 and included in EM&A Report – November 2016
54	16 November 2016	1823	CE 45/2008 - 54	Noise	Not evidenced	Interim IR was submitted to EPD on 5 December 2016 and included in EM&A Report – November 2016
55	19 December 2016	project hotline	CE 45/2008 - 55	Noise	Project related	Interim IR was submitted to EPD on 5 January 2017 and included in EM&A Report – December 2016
56	3 January 2017	DSD	CE 45/2008 - 56	Water quality	Project related	Interim IR was submitted to EPD on 8 February 2017 and included in EM&A Report – January 2017
57	16 January 2017	1823	CE 45/2008 - 57	Muddy water	Non-project related	Interim IR was submitted to EPD on 23 January 2017 and included in EM&A Report – January 2017
58	25 January 2017	EPD	CE 45/2008 - 58	Water quality	Project related	Interim IR was submitted to EPD on 2 March 2017 and included in EM&A Report – February 2017
59	January 2017	EPD	CE 45/2008 - 59	Noise	Invalid	Interim IR was submitted to EPD on 14 March 2017 and included in EM&A Report – March 2017
60	6 and 7 March 2017	RE	CE 45/2008 - 60	Noise	Invalid	Interim IR was submitted to EPD on 27 April 2017 and included in EM&A Report – April 2017
61	24 March 2017	1823	CE 45/2008 - 61	Noise	Non-project related	Interim IR was submitted to EPD on 6 April 2017 and included in EM&A Report – March 2017
62	1 April 2017	Contract 2's hotline	CE 45/2008 - 62	Noise	Invalid	Interim IR was submitted to EPD on 8 May 2017 and included in EM&A Report – April 2017



63	10 April 2017	1823	CE 45/2008 - 63	Muddy water	Non-project related	Interim IR was submitted to EPD on 2 May 2017 and included in EM&A Report – April 2017
64	4 August 2017	EPD	CE 45/2008 - 64	Water quality	Project related	Interim IR was submitted to EPD on 11 August 2017 and included in EM&A Report – July 2017
65	30 August 2017	Contract 6's Project Hotline	CE 45/2008 - 65	Muddy water and Dust	Project related	Interim IR was submitted to EPD on 2 November 2017 and included in EM&A Report – October 2017
66	8 September 2017	Contract 6's Project Hotline	CE 45/2008 - 66	Muddy water and Dust	Project related	Interim IR was submitted to EPD on 9 November 2017 and included in EM&A Report – October 2017
67	by 1823 on 23 September 2017 and referred to AECOM on 25 October 2017	1823	CE 45/2008 - 67	Muddy water and Dust	Invalid	Interim IR was submitted to EPD on 13 November 2017 and included in EM&A Report – October 2017
68	7 and 21 November 2017	1823	CE 45/2008 - 68	Dust	Non-project related	Interim IR was submitted to EPD on 24 November 2017 and included in EM&A Report – November 2017
69	27 September 2017	Police Hotline	CE 45/2008 – 69a	Noise	invalid	Interim IR was submitted to EPD on 30 November 2017 and included in EM&A Report – November 2017
70	27 December 2017	1823	CE 45/2008 – 69b	Dust	Project related	Interim IR was submitted to EPD on 4 January 2018 and included in EM&A Report – December 2017
71	28 December 2017	CEDD	CE 45/2008 – 70	Noise	Project related	Interim IR was submitted to EPD on 27 February 2018 and included in EM&A Report – February 2018
72	24 January 2018	EPD	CE 45/2008 – 71	Waste Management	Project related	Interim IR was submitted to EPD on 6 March 2018 and included in EM&A Report – February 2018



78	15 August 2018 5 October 2018	Project hotline	CE 45/2008 – 76  CE 45/2008 – 77	Muddy water  Dust	Project related  Non-project related	September 2018 and included in EM&A Report – August 2018 Interim IR was submitted to EPD on 22 October 2018 and included in EM&A Report – October 2018 Interim IR was
79	5 October 2018	1823	CE 45/2008 – 78	Wastewater and Noise	Partly Project related	submitted to EPD on 4 November 2018 and included in EM&A Report – October 2018
80	25 October 2018	1823	CE 45/2008 – 79	Dust	Non-project related	Interim IR was submitted to EPD on 5 November 2018 and included in EM&A Report – October 2018
81	19 November 2018	EPD	CE 45/2008 – 80	Dust	Project related	Interim IR was submitted to EPD on 27 December 2018 and included in EM&A Report – December 2018
82	13 December 2018	1823	CE 45/2008 - 81	Dust	Project related	Interim IR was submitted to EPD on 9 January 2019 and included in EM&A Report – December 2018



83	19 August 2018	1823	CE 45/2008 – 82	Dust	Non-project related	Interim IR was submitted to EPD on 8 February 2019 and included in EM&A Report – January 2019
84	29 November 2018	1823	CE 45/2008 – 83	Dust and wastewater	Non-project related	Interim IR was submitted to EPD on 25 February 2019 and included in EM&A Report – February 2019
85	30 January 2019	EPD	CE 45/2008 – 84	Dust	Non-project related	Interim IR was submitted to EPD on 21 February 2019 and included in EM&A Report – February 2019
86	28 January 2019	EPD	CE 45/2008 – 85	Noise	Non-project related	Interim IR was submitted to EPD on 8 March 2019 and included in EM&A Report – February 2019
87	21 February 2019	1823	CE 45/2008 – 86	Dust and wastewater	Project related	Interim IR was submitted to EPD on 8 March 2019 and included in EM&A Report – February 2019
88	12 March 2019	1823	CE 45/2008 – 87	Wastewater	Project related	Interim IR was submitted to EPD on 9 April 2019 and included in EM&A Report – March 2019
89	13 March 2019	1823	CE 45/2008 – 88	Noise	Non-project related	Interim IR was submitted to EPD on 4 June 2019 and included in EM&A Report – May 2019
90	Early March 2020	EPD	CE 45/2008 – 89	Noise and dust	Non-project related	Interim IR was submitted to EPD on 8 April 2020 and included in EM&A Report – March 2020

<sup>(\*)</sup> Not for reporting used.

**Environmental Complaint Log for SS C505** 

Environmental Complaint Log for 55 C303						
Log ref.	Date of complaint	Complaint route	Reference no.	Complaint nature	Investigation fining	Status
1	20 June 2016	1823	SS C505 – 01a	Noise	Project related	Interim IR was submitted to EPD on 14 July 2016 and included in EM&A Report – July 2016
2	30 August 2017	CEDD Project Hotline	SS C505 – 01b	Muddy water and Dust	Project related	Interim IR was submitted to EPD on 6 November 2017 and included in EM&A Report – October 2017



3	4 March 2018	1823	SS C505 – 02	Muddy water and Dust	Non-project related	Interim IR was submitted to EPD on 28 March 2018 and included in EM&A Report – March 2018
4	29 April 2018	ArchSD	SS C505 – 03	Muddy water	Non-project related	Interim IR was submitted to EPD on 5 June 2018 and included in EM&A Report – May 2018
5	29 November 2018	1823	SS C505 – 04	Dust and wastewater	Non-project related	Interim IR was submitted to EPD on 21 February 2019 and included in EM&A Report – February 2019
6	19 August 2018	1823	SS C505 – 05	Dust	Non-project related	Interim IR was submitted to EPD on 4 February 2019 and included in EM&A Report – January 2019
7	8 January 2020	EPD	SS C505 – 06	Water quality	Non-project related	Interim IR was submitted to EPD on 19 February 2019 and included in EM&A Report – February 2019