

JOB NO.: TCS01267/22

CONTRACT NO. EP/SP/186/21

WEST NEW TERRITORIES LANDFILL EXTENSION

MONTHLY ENVIRONMENTAL MONITORING AND AUDIT REPORT – JULY 2025

PREPARED FOR

HONG KONG RESOURCES RECOVERY PARK

Date Reference No. Prepared By Certified By

12 August 2025 TCS01325/23/600/R0133v1

Ben Tam (Senior Environmental Consultant)

Tam Tak Wing (Environmental Team Leader)

Version	Date	Remarks
1	12 August 2025	First Submission



Our Ref: TCS01325/23/300/L0134

Hong Kong Resources Recovery Park

29/F China Overseas Building, 139 Hennessy Road, Hong Kong

Attn: Mr. Kenneth Lau

13 August 2025 By email

Dear Sir.

Contract No. EP/SP/186/21

West New Territories Landfill (WENT) Extension EP-393/2010/A and FEP-01/393/2010/A Condition 3.5

ETL's Certification Letter for

Monthly Environmental Monitoring and Audit Report – July 2025

With reference to the Monthly Environmental Monitoring and Audit Report - July 2025 (TCS01325/23/600/R0133v1), we hereby certify this submission in accordance with Condition 3.5 of EP-393/2010/A and FEP-01/393/2010/A.

Should you have any queries or require further information, please feel free to the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours sincerely, For and on Behalf of

Action-United Environmental Services & Consulting

Tam Tak Wing

Environmental Team Leader





Environmental Protection Department

2nd floor, West Wing

Island West Transfer Station

88 Victoria Road

Kennedy Town

Hong Kong

Your reference:

Our reference:

HKEPD259/50/110704

Date:

14 August 2025

Attention: Ms Kins Lo

BY EMAIL & POST (email: wklo@epd.gov.hk)

Dear Sirs

Quotation Ref. 23-02230 Provision of Independent Environmental Checker Consultancy Services for

West New Territories Landfill Extension

Monthly Environmental Monitoring and Audit Report – July 2025

We refer to email of 12 August 2025 from Hong Kong Resources Recovery Park attaching the Monthly Environment Monitoring and Audit Report – July 2025 of the captioned.

We have no comment and hereby verify the captioned report in accordance with Clause 3.5 of the Environmental Permit (EP No.: EP-393/2010/A) and Further Environmental Permit (FEP No. FEP-01/393/2010/A).

Should you have any queries, please do not hesitate to contact the undersigned or our Mr Ricky Lau at 2618 2831.

Yours faithfully

ANEWR CONSULTING LIMITED

James Choi

Independent Environmental Checker

CPSJ/LCCR/thy



EXECUTIVE SUMMARY

INTRODUCTION

- ES.01 In August 2023, Hong Kong Resources Recovery Park (hereinafter named "HKRRP" or "the Contractor") was awarded the Design, Build and Operate (DBO) Contract of Contract No. EP/SP/186/21 West New Territories Landfill Extension (hereinafter named "the Project"). Further Environmental Permit no. FEP-01/393/2010/A (hereinafter named "the EP") was granted to HKRRP from Environmental Protection Department (EPD) on 6 October 2023.
- ES.02 Action-United Environmental Services & Consulting (hereinafter called "AUES") was appointed by HKRRP as the Environmental Team (the "ET") to implement environmental monitoring and auditing (EM&A) programme for the initial phase of the Project.
- ES.03 This is the 16th Monthly EM&A Report presenting the monitoring results and inspection findings for the Project for the period from 1st to 31st July 2025 (hereinafter called 'the Reporting Period).

ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES

ES.04 Environmental monitoring activities under the EM&A programme of the Project in the Reporting Period are summarized in the following table.

Environmental Aspect	Monitoring Parameter	Monitoring Station/ Location	Date / Number of Monitoring	
A in Ovalita	1-hour Total Suspended Particulates	AM(D)1, AM(D)2,	180 sessions	
Air Quality	24-hour Total Suspended Particulates	AM(D)3, AM(D)5a, AM(D)6a, AM(D)7a	60 sessions	
Noise	L _{eq(30min)} Daytime	NM1	5 sessions	
Water Quality (Surface water)			1 session (16 th July 2025)	
Site Inspection	Site audit for implementation of mitigation measures	Entire site	5 sessions	

ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE

ES.05 In the Reporting Period no exceedances of air quality monitoring, construction noise (including Action Level for noise complaint) and surface water monitoring were recorded. The summary of exceedances recorded in the Reporting Period is shown table below.

Envisormental	Manitanina	A a4: a ==	Limit		Event & Action		
Environmental Aspect	Monitoring Parameters		Level	NOE Issued	Investigation Result	Corrective Actions	
Aim Ovality	1-hour TSP	0	0	0			
Air Quality	24-hour TSP	0	0	0			
Construction Noise	L _{eq(30min)} Daytime	0	0	0			
	DO	0	0	0			
Water Quality	Turbidity	0	0	0			
(Surface water)	рН	0	0	0			
	SS	0	0	0			



- ES.06 The LFG monitoring was conducted for excavation work in July 2025. No exceedance of Limit Levels of LFG was recorded during the Reporting Period.
- ES.07 For landscape and visual, implementation of mitigation measures during construction phase of the Project has been monitored through regular site inspection/ audit.
- ES.08 The Contractor was advised to implement the waste management plan and minimise the wastes generated through recycling or reusing. All mitigation measures stipulated in the updated EM&A Manual and waste management plans shall be fully implemented.

SITE INSPECTION

ES.09 In the Reporting Period, weekly joint site inspection to evaluate the site environmental performance had been carried out by the representatives of the Service Manager (SM), ET and the Contractor. No non-compliance was noted during the site inspection. In addition, Independent Environmental Checker (IEC) carried out the joint site inspections on 10th July 2025.

ENVIRONMENTAL COMPLAINT

ES.10 In the Reporting Period, no environmental complaint was received.

NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

ES.11 In the Reporting Period, no environmental summons and prosecutions were recorded.

REPORTING CHANGE

ES.12 There is no reporting change in the Reporting Period.

FUTURE KEY ISSUES

- ES.13 Water quality mitigation measures shall be fully implemented in accordance with the Implementation Schedule for Environmental Mitigation Measures of the updated EM&A Manual.
- ES.14 In addition, the Contractor should fully implement the recommended air quality mitigation measures to minimize the impact of construction dust as far as practicable.
- ES.15 Construction noise would be a key environmental issue during construction work of the Project. In accordance with the EP, a noise bund of 3.5m tall has been constructed along the north eastern seafront of the existing landfill as shown in Figure 2 of the EP prior to the commencement of construction. It is reminded that the noise bund shall be properly maintained during the construction, operation and restoration of the Project.



Table of Contents

1		ODUCTION	1
	1.1	BACKGROUND	1
	1.2	DESCRIPTION OF THE PROJECT	1
	1.3	IMPLEMENTATION OF EM&A PROGRAMME	1
	1.4	REPORT STRUCTURE	2
2	CONS	TRUCTION PROGRESS AND PROJECT ORGANISATION	3 3
	2.1	Project Organisation	3
	2.2	Construction Progress	4
	2.3	SUMMARY OF ENVIRONMENTAL LICENSES AND PERMITS	4
3	AIR Q	UALITY MONITORING	7
	3.1	MONITORING REQUIREMENTS	7
	3.2	MONITORING PARAMETER, FREQUENCY AND DURATION	7
	3.3	MONITORING LOCATIONS	7
	3.4	MONITORING EQUIPMENT	9
	3.5	MONITORING PROCEDURES	10
	3.6	ACTION/LIMIT LEVELS FOR AIR QUALITY	11
	3.7	AIR QUALITY MONITORING RESULTS	11
4	CONS	TRUCTION NOISE MONITORING	13
	4.1	MONITORING REQUIREMENTS	13
	4.2	MONITORING PARAMETER, FREQUENCY AND DURATION	13
	4.3	MONITORING LOCATIONS	13
	4.4	MONITORING EQUIPMENT	13
	4.5	MONITORING PROCEDURES	14
	4.6	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE	14
	4.7	Noise Monitoring Results	14
5	WATE	R QUALITY MONITORING	16
	5.1	MONITORING REQUIREMENTS	16
	5.2	MONITORING FREQUENCY AND DURATION	16
	5.3	MONITORING LOCATIONS	16
	5.4	Analysis Parameters	16
	5.5	MONITORING EQUIPMENT	16
	5.6	LABORATORY ANALYSIS	17
	5.7	MONITORING PROCEDURES	18
	5.8	DATA MANAGEMENT AND QUALITY ASSURANCE (QA)/QUALITY CONTROL (QC)	18
	5.9	RESULTS OF SURFACE WATER QUALITY MONITORING	19
6	ECOL	OGY MONITORING	20
	6.1	REQUIREMENTS	20
	6.2	ECOLOGICAL MITIGATION MEASURES	20
	6.3	MONITORING AND AUDIT FOR ECOLOGY	20
7	LAND	SCAPE AND VISUAL MONITORING	22
	7.1	MONITORING REQUIREMENTS	22
	7.2	MONITORING AND OBSERVATION	22
8	LAND	FILL GAS MONITORING	23
	8.1	REQUIREMENT	23
	8.2	MONITORING PARAMETERS	23
	8.3	MONITORING EQUIPMENT	23
	8.4	MONITORING LOCATIONS	24
	8.5	MONITORING FREQUENCY	24
	8.6	A/L LEVELS AND EVENT ACTION PLAN	25
	8.7	MONITORING RESULTS	26
9	WAST	E MANAGEMENT	27

Contract No. EP/SP/186/21 **AUES West New Territories Landfill Extension Monthly Environmental Monitoring & Audit Report – July 2025** 9.1 GENERAL WASTE MANAGEMENT 27 9.2 RECORDS OF WASTE QUANTITIES 27 10 SITE INSPECTION 28 10.1 28 REQUIREMENTS 10.2 FINDINGS / DEFICIENCIES DURING THE REPORTING PERIOD 28 11 ENVIRONMENTAL COMPLAINTS AND NON-COMPLIANCES 30 11.1 ENVIRONMENTAL COMPLAINTS, SUMMONS AND PROSECUTIONS 30 11.2 OTHER ENVIRONMENTAL NON-COMPLIANCES 30 12 IMPLEMENTATION STATUS OF MITIGATION MEASURES 31 12.1 31 GENERAL REQUIREMENTS 12.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH 31 12.3 KEY ISSUES FOR THE COMING MONTH 31 13 CONCLUSIONS AND RECOMMENDATIONS 33 13.1 **CONCLUSIONS** 33 13.2 RECOMMENDATIONS 33



LIST OF TABLES

I ABLE 2-1	STATUS OF ENVIRONMENTAL LICENSES AND PERMITS
TABLE 3-1	DUST MONITORING LOCATIONS
TABLE 3-2	1-HOUR TSP AIR QUALITY MONITORING EQUIPMENT
TABLE 3-3	24-HOUR TSP AIR QUALITY MONITORING EQUIPMENT
TABLE 3-4	ACTION AND LIMIT LEVELS FOR AIR QUALITY MONITORING
TABLE 3-5	SUMMARY OF 1-HOUR TSP MONITORING RESULTS
TABLE 3-6	SUMMARY OF 24-HOUR TSP MONITORING RESULTS
Table 4-1	CONSTRUCTION NOISE MONITORING STATION
TABLE 4-2	NOISE MONITORING EQUIPMENT
TABLE 4-3	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE
Table 4-4	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS
TABLE 5-1	SURFACE WATER MONITORING INSTRUMENT
TABLE 5-2	TEST METHOD AND REPORTING LIMIT OF CHEMICALS ANALYSIS
TABLE 5-3	ACTION AND LIMIT LEVELS FOR SURFACE WATER MONITORING DURING CONSTRUCTION PHASE
Table 8-1	LFG MONITORING EQUIPMENT
Table 9-1	SUMMARY OF QUANTITIES OF INERT C&D MATERIALS
Table 9-2	SUMMARY OF QUANTITIES OF NON-INERT C&D WASTES
Table 10-1	SITE INSPECTION AND OBSERVATIONS
Table 11-1	STATISTICAL SUMMARY OF ENVIRONMENTAL COMPLAINTS
TABLE 11-2	STATISTICAL SUMMARY OF ENVIRONMENTAL SUMMONS
TABLE 11-3	STATISTICAL SUMMARY OF ENVIRONMENTAL PROSECUTION

LIST OF APPENDICES

APPENDIX A	LOCATION PLAN OF ENHANCED SCHEME OF WENTX LANDFILL EXTENSION		
APPENDIX B	PROJECT ORGANIZATION AND THE KEY PERSONAL CONTACT		
APPENDIX C	3-MONTH ROLLING CONSTRUCTION PROGRAMME		
APPENDIX D	MONITORING LOCATIONS		
APPENDIX E	CALIBRATION CERTIFICATES		
	(1) AIR QUALITY MONITORING EQUIPMENT		
	(2) NOISE MONITORING EQUIPMENT		
	(3) WATER QUALITY MONITORING EQUIPMENT		
	(4) LFG MONITORING EQUIPMENT		
APPENDIX F	METEOROLOGICAL DATA		
APPENDIX G	EVENT AND ACTION PLAN		
APPENDIX H	MONITORING SCHEDULE		
APPENDIX I	DETAILED MONITORING RESULTS		
APPENDIX J	GRAPHICAL PLOTS FOR MONITORING RESULT		
APPENDIX K	WASTE FLOW TABLE		
APPENDIX L	ENVIRONMENTAL COMPLAINTS LOG		
APPENDIX M	ENVIRONMENTAL MITIGATION IMPLEMENTATION SCHEDULE		
APPENDIX N	INVESTIGATION REPORT		
APPENDIX O	ENVIRONMENTAL REVIEW REPORT FOR HANDLING OF CONSTRUCTION MATERIALS		
APPENDIX P	HABITAT MAP AND PHOTO RECORD FOR 132KV CABLE		
AI FENDIA I	TIADITAL MIALAND LITUTU RECURD FOR 132K V CADLE		



1 INTRODUCTION

1.1 BACKGROUND

- 1.1.1 The West New Territories Landfill Extension (WENTX) is classified as a Designated Project (DP) under Schedule 2, Part I of the Environmental Impact Assessment Ordinance (EIAO) (Cap. 499). The Environmental Impact Assessment (EIA) Report (AEIAR-147/2009) of WENTX was approved in November 2009 and the respective Environmental Permit no. EP-393/2010 was granted in June 2010. For the WENTX development scheme adopted in the WENTX-EIA in 2009 (hereby referred to the Original Scheme), an area of about 188 hectares of land adjacent to the existing WENT landfill was considered that to be provided approximately 81 million m³ (Mm³) of additional landfill capacity.
- 1.1.2 In consideration of the interfacing projects, commitments and neighbourhood enhancement initiatives were proposed and in conjunction with the project, the reference design and implementation programme for the WENTX (hereby referred to the Enhanced Scheme) has been revised. Under the Enhanced Scheme, the boundary of WENTX has been reduced and the waste filling area and landfill capacity has been updated to 94 ha and 76 Mm³ respectively. Variation of Environmental Permit (application number VEP-617/2022) was applied by the project proponent and EP-393/2010/A was issued by Environmental Protection Department (EPD) on 29 July 2022 subsequently. The location plan of Enhanced Scheme of WENTX Landfill Extension is shown on *Appendix A*.
- 1.1.3 In August 2023, Hong Kong Resources Recovery Park (hereinafter named "HKRRP" or "the Contractor") was awarded the Design, Build and Operate (DBO) Contract of WENTX (hereinafter named "the Project"). Further Environmental Permit no. FEP-01/393/2010/A (hereinafter named "the EP") was granted to HKRRP from EPD on 6 October 2023.

1.2 DESCRIPTION OF THE PROJECT

General Description of the Project

- 1.2.1 The development of the WENT Landfill Extension will involve the following works:
 - Site formation and preparation;
 - Installation of landfill infrastructures including leachate treatment plant, landfill gas management plant, power generators, workshops and site offices;
 - Installation of liner system;
 - Installation of leachate collection, treatment and disposal facilities;
 - Installation of gas collection and utilization facilities;
 - Provision of utilities and drainage;
 - Landfill operation;
 - Restoration and aftercare in subsequent stages; and
 - Implementation of measures to mitigate environmental impact as well as environmental monitoring and audit.

1.3 IMPLEMENTATION OF EM&A PROGRAMME

- 1.3.1 Action-United Environmental Services & Consulting (hereinafter called "AUES") was appointed by HKRRP as the Environmental Team (ET) to implement environmental monitoring and auditing (EM&A) programme for the initial phase of the Project.
- 1.3.2 In accordance with EP-393/2010/A and FEP-01/393/2010/A Condition 3.1, an updated EM&A Manual has been prepared to include the latest EM&A requirement in accordance with the information and recommendation described in the EIA Report and by taking into account any specific site conditions that may be changed before the construction of the Project. It



outlines the monitoring and audit programme for the Project for the construction phase and provided systematic procedures for monitoring, auditing and minimizing environmental impacts ensure compliance with the EIA recommendations.

- 1.3.3 Baseline monitoring for air quality and background noise were conducted from 3rd January 2024 to 31st March 2024 by the ET at all the designated or any alternative monitoring locations in accordance with the updated EM&A Manual. In addition, surface water quality baseline monitoring were conducted from 20th February to 1st March 2024. During the monitoring period, no construction activities under the Project or other external influencing factors of significant concern were observed. Baseline Monitoring Report has been prepared to present the relevant baseline data and determine the set of Action and Limit Levels (A/L Levels) for the construction phase of the Project.
- 1.3.4 In view of commencement of construction work of Project on 3rd April 2024, the Construction Phase EM&A monitoring for relevant impact monitoring was commenced subsequently.
- 1.3.5 This is the 16th Monthly EM&A Report, presenting the monitoring results and inspection findings for the Project, for the period from 1st to 31st July 2025 (hereinafter called 'the Reporting Period).

1.4 REPORT STRUCTURE

- 1.4.1 The Monthly EM&A Report is structured into the following sections:-
 - **Section 1** Introduction
 - Section 2 Project Organization and Construction Progress
 - Section 3 Summary of Impact Monitoring Requirements
 - **Section 4** Air Quality Monitoring
 - **Section 5** Construction Noise Monitoring
 - Section 6 Water Quality Monitoring
 - Section 7 Ecology Monitoring
 - **Section 8** Landfill Gas Monitoring
 - **Section 9** Waste Management
 - **Section 10** Site Inspections
 - Section 11 Environmental Complaints and Non-Compliances
 - **Section 12** Implementation Status of Mitigation Measures
 - **Section 13** Conclusions and Recommendations



2 CONSTRUCTION PROGRESS AND PROJECT ORGANISATION

2.1 PROJECT ORGANISATION

2.1.1 The project organization and the key personal contact are shown in *Appendix B*, which consists of the Project Proponent (EPD / Environmental Infrastructure Division), Contractor, ET, Independent Environmental Checker (IEC), and Service Manager (SM) etc. It should be established to take the responsibilities for environmental protection for this landfill extension project. The IEC will be appointed by the Project Proponent to conduct independent auditing of the overall EM&A programme including environmental and operation monitoring, implementation of mitigation measures, EM&A submissions, and any other submissions required under the EP. The individual responsibilities are:

Environmental Protection Department (EPD)

EPD/ Environmental Infrastructure Division is the Project Proponent of the Project.

Contractor

- Employment of an ET to carry out environmental monitoring, laboratory analysis and reporting of environmental monitoring and audit;
- Submission of proposals of mitigation measures in case of exceedances of Action and Limit (A/L) Levels in accordance with the Event and Action Plan (EAP);
- Implementation of mitigation measures to reduce the impacts where A/L Levels are exceeded; and
- Adherence to the agreed procedures for carrying out complaint investigation.

ET

- Setting up of all the required environmental monitoring stations;
- Monitoring of various environmental parameters as required;
- Analysis of monitoring and audit data and review the success of EM&A programme to cost-effectively confirm the adequacy of mitigation measures implemented and the validity of the EIA predictions and to identify any adverse environmental impacts arising;
- Carrying out site inspections to investigate and audit the Contractor's site practices, equipment and work methodologies with respect to pollution control and environmental mitigation, and take proactive actions to resolve problems;
- Auditing and preparation of audit reports on environmental monitoring data and site conditions;
- Reporting of environmental monitoring and audit results to the IEC, Contractor, SM and Project Proponent or its delegated representative;
- Recommendation of suitable mitigation measures to the Contractor in case exceedance of A/L Levels in accordance with the EAP;
- Undertaking of regular on-site audits/ inspections and reporting to the Contractor and SM of any potential non-compliance; and
- Following up and closing out of non-compliance actions.

IEC

- Review of EM&A programme by the ET (at not less than monthly intervals);
- Auditing of monitoring activities and results (at not less than monthly intervals);
- Reporting of audit results to the SM and Project Proponent in parallel;
- Reviewing of EM&A reports (monthly, quarterly and annual summary reports) submitted by the ET;
- Reviewing of proposal of mitigation measures submitted by the Contractor in accordance with the EAP;
- Checking of mitigation measures recommended in the EIA Report and EM&A Manual, and ensuring they are properly implemented in timely manner when required; and



- Reporting of findings of site inspections and other environmental performance reviews to SM and Project Proponent.
- To check the records of disposal for the different types of C&D materials, including the DRS maintained by the Contractor during the monthly environmental auditing;
- To check the disposal records kept by the SM, especially the name of the designated public fill reception facilities, sorting facilities, outlying island transfer facilities, landfills and/or alternative disposal grounds, the time and date of disposal.

SM

- Verification and checking Contractor's activities and ensure that the requirements in the EM&A Manual are fully complied with;
- Informing Contractor when action is required to reduce impacts in accordance with the EAP; and
- Ensure compliance with the agreed EAP in case any exceedance.
- 2.1.2 Sufficient and suitably qualified professional and technical staff should be employed by the respective parties to ensure full compliance with their duties and responsibilities, as required under the EM&A programme for the duration of the Project.

2.2 CONSTRUCTION PROGRESS

2.2.1 The 3-month rolling construction programme of the Project are shown in *Appendix C*, and the major construction activities carried out in the Reporting Period are listed below:-

Portion A1, B1a, B1c & B6

- Soft excavation
- Hard excavation
- Blasting
- 132kV substation construction

Portion B10

• Leachate Treatment Works & Landfill Gas Treatment Plant

Portion C1

- External Manholes Construction
- Temporary Drainage Diversion at Nullah
- Construction of new haul road

Portion B2 & B9

- J-Channel Construction
- Pilling Works
- Temporary Drainage Channel and Concrete Block Wall Installation
- DCM & DJM Works

Portion D1

• Pipe Laying Works

Portion F

• Rock Crushing

2.3 SUMMARY OF ENVIRONMENTAL LICENSES AND PERMITS

2.3.1 To implement the project works, summary of the relevant permits, licenses, and/or notifications on environmental protection are presented in *Table 2-1*.



Table 2-1 Status of Environmental Licenses and Permits

	License/Permit Status				
Item	Description	Ref. no.	Effective Date	Expiry Date	
1	Environmental Permit	FEP-01/393/2010/A	6 Oct 2023		
2	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7048594	22 Sep 2023		
3	Chemical Waste Producer Registration	WPN: 5213-4361-1- H4441-01	18 Oct 2023		
4	Water Pollution Control Ordinance - Discharge	WT10002363-2023 (Portion C1)	6 May 2024	31 May 2029	
	License	WT10002525-2023 (Portion B1a)	6 May 2024	31 May 2029	
		WT00045324-2024 (Portion B2)	12 Dec 2024	31 Dec 2029	
		WT00045991-2025 (Portion B10)	14 Mar 2025	31 Mar 2030	
5	Noise Control Ordinance – Construction Noise	GW-RW0629-25 (Portion C1)	27 Jun 2025	26 Sep 2025	
	Permit	GW-RW0627-25 (Portion B10)	27 Jun 2025	26 Sep 2025	
		GW-RW0309-25 (Portion B1a)	10 Apr 2025	9 Jul 2025	
		GW-RW0651-25 (Portion B1a)	10 Jul 2025	9 Jan 2026	
		GW-RW0430-25 (Portion B2)	8 May 2025	7 Aug 2025	
		GW-RW0427-25 (Portion B4)	8 May 2025	7 Aug 2025	
		GW-RW0364-25 (Portion B9)	17 Apr 2025	16 Jul 2025	
		GW-RW0684-25 (Portion B9)	17 Jul 2025	16 Jan 2026	
		GW-RW0502-25 (Portion D1)	2 Jun 2025	1 Sep 2025	
		GW-RW0498-25 (Portion F)	1 Jun 2025	31 Aug 2025	
6	Licence for the Conduct of a Specified Process (SP License)	L-11-058(1) Mineral Works (Stone Crushing Plant)	29 Apr 2025	28 Apr 2030	
		L-3-274(1) Cement Silo	27 May 2025	26 May 2030	



2.3.2 Temporary crushing plant had been setup at Portion F1 and F2 under the Project. The proposed operation period of the proposed crushing plant is commenced in August 2025. As the processing capacity of the proposed mobile rock crushing plant exceeds 5,000 tonnes per annum, an application for a specified process license (SP License) has been obtained by the Contractor under the Air Pollution Control Ordinance. Moreover, the Environmental Review Report for the handling of construction materials for the crushing plant which verified by IEC is illustrated in *Appendix O*.



3 AIR QUALITY MONITORING

3.1 MONITORING REQUIREMENTS

- 3.1.1 Monitoring of the Total Suspended Particulate (TSP) levels shall be carried out by the ET to ensure that any deteriorating air quality could be readily detected and timely action be taken to rectify the situation. 1-hour and 24-hour TSP levels should be measured to indicate the impacts of construction dust on air quality. The TSP levels shall be measured by following the standard high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, USA, Chapter 1 (Part 50), Appendix B. Upon approval by the IEC, 1-hour TSP levels can be measured by direct reading methods which are capable of producing comparable results as that by the high volume sampling method, to indicate short event impacts.
- 3.1.2 All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and other special phenomena and work progress of the concerned site etc. shall be recorded down in details.
- 3.1.3 The ET shall carry out impact monitoring during the course of the Works. In case of non-compliance with the dust criteria, more frequent monitoring exercise, as specified in the Action Plan, shall be conducted within 24 hours after the result is obtained. This additional monitoring shall be continued until the excessive dust emission or the deterioration in air quality is rectified.

3.2 MONITORING PARAMETER, FREQUENCY AND DURATION

3.2.1 In accordance with the EP requirement, for regular impact monitoring, the sampling frequency of at least twice in every six-days, shall be strictly observed at all the monitoring stations for 24-hr TSP monitoring. For 1-hr TSP monitoring, the sampling frequency of at least six times in every six-days should be undertaken when the highest dust impact occurs. The specific time to start and stop the 24-hr TSP monitoring shall be clearly defined for each location and be strictly followed by the Contractor.

3.3 MONITORING LOCATIONS

- 3.3.1 Five dust monitoring locations have been recommended in the approved Final EM&A Manual and two additional monitoring stations (AM(D)6 and AM(D)7) were suggested in VEP supporting document. Joint site visits by the Contractor and ET have been conducted at the recommended locations to verify their status and obtain agreement to install dust monitoring equipment for before the implementation of EM&A Programme.
- 3.3.2 When alternative monitoring locations are proposed, the following criteria, as far as practicable, should be followed:
 - At the site boundary or such locations close to the major dust emission source;
 - Close to the sensitive receptors; and
 - Account for the prevailing meteorological conditions

Proposed Alternative Locations

AM(D)4

A formal email has been sent to Black Point Power Station on 27th December 2023 for access authorization to the premise in order to carry out dust monitoring. The corresponding team of Black Point Power Station replied that due to the safety and security reason, they rejected to provide access for dust monitoring activities in their premise. The only available location for monitoring is at the main access road of the premises, which is directly affected by traffic dust. It is unclear whether this location accurately represents the dust impact from either the traffic



or the WENTX site, therefore, this location is considered unsuitable.

After AM(D)4 (Black Point Power Station Office and Control Room) rejected the proposal of installing dust monitoring equipment within their premises, alternative locations were sought which included locations near the Lung Kwu Sheung Tan Village Supply Tank and Lung Kwu Sheung Tan Service Reservoir. Visits to the above two locations were made for 4 weeks after the rejection from Black Point Power Station on 18 January 2024. It was concluded that there was no site personnel permanently stationed at these two locations and these premises are probably visited by personnel on an ad-hoc basis. Furthermore, it was observed that these premises have no window and air conditioning equipped, no site personnel was on duty at the building during site visit. With the implementation of the dust suppression measures stipulated in Air Pollution Control (Construction Dust) Regulation, adverse air quality impact is not anticipated at these two locations, and there are no other ASRs on the west side of the Project site. Thus, it was concluded that no further alternative location can be considered.

<u>AM(D)5</u>

During baseline monitoring conducted at AM(D)5 on 27^{th} Jan to 9^{th} Feb 2024, it has been observed that 9 out of 14 monitoring days recorded 24-hour TSP levels exceeding the Limit Level ($260\mu g/m^3$). Investigation was conducted to identify cause of high baseline 24-hour TSP result, and it is considered that the frequent passage of heavy vehicles, particularly on the unpaved access road to the nearby warehouses, was the main contributing factor to the elevated 24-hour TSP levels. As the baseline level for 24-hour TSP at AM(D)5 exceeded the limit level, and the exceedances were due to the local traffic. In accordance with the updated EM&A Manual, ET had conducted a second set of baseline monitoring at new location closer to the WENTX site, which demonstrate a more representative data on dust impact associated from WENTX (hereinafter named AM(D)5a) for the parameters of 1-hour and 24-hour TSP from 16^{th} to 31^{st} March 2024.

AM(D)6

Site visit and meeting with $T \cdot Park$ was held on 15^{th} January 2024 and it is concluded and agreed that air quality monitoring equipment should be relocated to the rooftop of $T \cdot Park$ workshop instead of the $T \cdot Park$ office, which is the best available alternative monitoring location in the facility. The distance between $T \cdot Park$ office and workshop is approximately 100m. They are both located to the north of the site boundary and experiencing the same prevailing meteorological conditions.

AM(D)7

Site visit was conducted at the proposed designated location on 28th December 2023, and after discussion with the management representative of the premises, access authorization to carry out dust monitoring was rejected due to unsuitable conditions.

An alternative location has been sought based on the recommended criteria. It is proposed to relocate the monitoring location (north facing) to the site boundary of Middle Tsang Tsui Ash Lagoon and at the location avoid the emission from the premises (east facing). The proposed alternative monitoring location AM(D)7a is approximately 10 meters away from the designated location AM(D)7. Both locations are situated to the north-west of the site boundary and experiencing the same prevailing meteorological conditions. The southern boundary of the Tsang Tsui Columbarium site such as the entrance area has been explored subsequently, but it is not feasible without stable electricity.

The updated dust monitoring locations have been included in the updated EM&A Manual. The proposed dust monitoring locations for impact monitoring are shown in *Table 3-1* and



illustrated in Appendix D.

Table 3-1 Dust Monitoring Locations

Station ID	ASR ID	Location	Land use
AM(D)1	A1-1	Ha Pak Nai	Residential
AM(D)2	A1-2	Ha Pak Nai	Residential
AM(D)3	A1-3	Ha Pak Nai	Residential
AM(D)5a	A4-1	Lung Kwu Sheung Tan	Place of Worship
AM(D)6a	A3-1	Rooftop of T·Park workshop	Office
AM(D)7a	A5-2	Site boundary of Middle Tsang Tsui Ash Lagoon	Community

3.3.3 The status and locations of dust sensitive receivers may change from time to time. If such cases exist, the ET Leader shall propose updated monitoring locations and seek approval from SM and IEC and agreement from EPD on the proposal.

3.4 MONITORING EQUIPMENT

1-hour TSP

- 3.4.1 Portable direct reading dust meters brand named "Sibata LD-5R Laser Dust monitor Particle Mass Profiler & Counter", "Sibata LD-3B Laser Dust monitor Particle Mass Profiler & Counter" and "Sidepak Personal Aerosol Monitor AM520" were used to 1-hour TSP measurement. These portable direct reading dust meters provided a real time 1-hour TSP measurement based on 90° light scattering.
- 3.4.2 The portable direct reading dust meters were used within the valid period following manufacturer's Operation and Service Manual. It was calibrated annually and determined periodically by the calibrated High-Volume Sampler to check the validity and accuracy of the results measured by direct reading method. The proposed use of portable direct reading dust meters was submitted to the IEC and obtained agreement and stated in *Section 4.3* of the Updated EM&A Manual.
- 3.4.3 The portable direct reading dust meters used for impact air quality monitoring are listed in *Table 3-2*. The copies of calibration certificates for 1-hour TSP air quality monitoring equipment are shown in *Appendix E1*.

Table 3-2 1-hour TSP Air Quality Monitoring Equipment

Equipment	Model	Serial No.		
	Sidepak Personal Aerosol	5202337003 (AUES Equipment No.		
Dantalala Duat	Monitor AM520	EQ119)		
Portable Dust Meter of	Sibata LD-3B Laser Dust	366410 (AUES Equipment No. EQ110)		
Particle Mass	monitor	456662 (AUES Equipment No. EQ118)		
Profiler &	Sibata LD-5R Laser Dust	467389 (AUES Equipment No. EQ125)		
Counter		467390 (AUES Equipment No. EQ126)		
Counter	monitor	467391 (AUES Equipment No. EQ127)		
		467392 (AUES Equipment No. EQ128)		

24-hour TSP

3.4.4 The 24-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the *Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50)*, Appendix *B*. The filter paper of 24-hour TSP measurement shall be provided and determined



by HOKLAS accredited laboratory. Equipment used for 24- hour TSP of impact air quality monitoring is listed in *Table 3-3*.

Table 3-3 24-hour TSP Air Quality Monitoring Equipment

Equipment	Model
High Volume Air Sampler	TISCH High Volume Air Sampler, HVS Model TE-5170
Calibration Kit	TISCH Model TE-5025A

- 3.4.5 The equipment used for 24-hour TSP measurement is a Tisch Environmental, Inc. Model TE-5170 TSP high volume air sampling system, which complied with EPA Code of Federal Regulation, Appendix B to Part 50. The High Volume Sampler (HVS) consists of the following:
 - (i) An anodized aluminum shelter;
 - (ii) A 8"x10" stainless steel filter holder;
 - (iii) A blower motor assembly;
 - (iv) A continuous flow/pressure recorder;
 - (v) A motor speed-voltage control/elapsed time indicator;
 - (vi) A 7-day mechanical timer, and
 - (vii) A power supply of 220v/50 Hz
- 3.4.6 Prior to the 24-hour TSP monitoring, the HVS was calibrated in accordance with the manufacturer's instruction using the NIST-certified standard calibrator (Tisch Calibration Kit Model TE-5025A). Valid calibration certificate of the calibration kit with the certificate of HVS calibrated are attached in *Appendix E1*.

Wind Data Monitoring Equipment

3.4.7 In consideration of the safety concerns of setting up wind sensor at 10m above ground, the ETL proposed alternative method to obtain representative wind data. Meteorological information as extracted from "the Hong Kong Observatory Lau Fau Shan Station" is alternative method to obtain representative wind data. Lau Fau Shan Station is located nearby the Project site. Moreover, Lau Fau Shan station is located at 31m above mean sea level which in compliance with the general setting up requirement. This station can also provide other meteorological information include air temperature, relative humidity, wind direction, wind speed and mean sea level pressure. Adoption of meteorological information from Hong Kong Observatory is a common alternative method for a lot of EM&A projects in Hong Kong.

3.5 MONITORING PROCEDURES

1-hour TSP

- 3.5.1 The portable direct reading dust meters brand named "Sibata LD-5R Laser Dust monitor Particle Mass Profiler & Counter", "Sibata LD-3B Laser Dust monitor Particle Mass Profiler & Counter" and "Sidepak Personal Aerosol Monitor AM520" was used for impact monitoring. It is a portable, battery-operated laser photometer and provides a real time 1-hour TSP measurement based on 90° light scattering.
- 3.5.2 The 1-hour TSP meter used is within the valid period, calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter was follow manufacturer's Operation and Service Manual.

24- hour TSP



- 3.5.3 Prior of 24-hour TSP monitoring, the HVS was calibrated in accordance with the manufacturer's instruction using the NIST-certified standard calibrator (Tisch Calibration Kit Model TE-5025A). The 24-hour TSP Monitoring using the HVS was also processed in accordance with the manufacturer's Operations Manual.
- 3.5.4 A filter paper of 24- hour TSP on filters of HVS collected by the ET would be delivered to ALS Technichem (HK) Pty Ltd (ALS) carry out quantifies. Also, ALS will keeps all the sampled 24-hour TSP filter papers in normal air conditioned room conditions, i.e. 70% RH (Relative Humidity) and 25°C, for six months prior to disposal.

3.6 ACTION/LIMIT LEVELS FOR AIR QUALITY

3.6.1 The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. Following the guidelines for establishing the Action and Limit Levels for air quality monitoring, the Action and Limit Levels are presented in *Table 3-4*. Should project-related non-compliance of the environmental quality criteria occur, remedial actions will be triggered according to the Event and Action Plan which is presented in *Appendix G*.

Table 3-4 Action and Limit Levels for Air Quality Monitoring

Manitaring	1-hour TSP		24-hour TSP		
Monitoring Station	Action Level (μg/m³)	Limit Level (µg /m³)	Action Level (μg/m³)	Limit Level (µg /m³)	
AM(D)1	317	500	155	260	
AM(D)2	313	500	156	260	
AM(D)3	334	500	155	260	
AM(D)5a	371	500	238	260	
AM(D)6a	294	500	159	260	
AM(D)7a	331	500	215	260	

3.7 AIR QUALITY MONITORING RESULTS

- 3.7.1 The monitoring schedule is presented in Appendix H and the monitoring results are summarized in the following sub-sections.
- 3.7.2 The monitoring results are summarized in *Tables 3-5 and Table 3-6*. The detailed 1-hour TSP and 24-hour monitoring results are provided in *Appendix I* and graphical plots of monitoring results are shown in *Appendix J*.

Table 3-5 Summary of 1-hour TSP Monitoring Results

1-hour TSP (μg/m³)					
Monitoring Station	Average (Range)	No. of Session	Action Level	Limit Level	
AM(D)1 - Village house at Ha Pak Nai	66 (31 – 124)	30	317	500	
AM(D)2 - Village house at Ha Pak Nai	54 (32 – 99)	30	313	500	
AM(D)3 - Village house at Ha Pak Nai	75 (31 – 131)	30	334	500	
AM(D)5a - Lung Kwu Sheung Tan	203 (107 – 285)	30	371	500	
AM(D)6a - Rooftop of T·Park Workshop	92 (45 – 183)	30	294	500	
AM(D)7a - Site boundary of Middle Tsang Tsui Ash Lagoon	128 (37 – 254)	30	331	500	



Table 3-6 Summary of 24-hour TSP Monitoring Results

24-hour TSP (μg/m³)					
Monitoring Station	Average (Range)	No. of Session	Action Level	Limit Level	
AM(D)1 - Village house at Ha Pak Nai	53 (17 – 119)	10	155	260	
AM(D)2 - Village house at Ha Pak Nai	37(22-60)	10	156	260	
AM(D)3 - Village house at Ha Pak Nai	53 (16 – 110)	10	155	260	
AM(D)5a - Lung Kwu Sheung Tan	164(90-233)	10	238	260	
AM(D)6a - Rooftop of T·Park Workshop	67 (39 – 137)	10	159	260	
AM(D)7a - Site boundary of Middle Tsang Tsui Ash Lagoon	102 (31 – 203)	10	215	260	

3.7.3 In the Reporting Period, all the 1-hour and 24-hour TSP monitoring results were below the Action/Limit Levels and no corrective action was therefore required.



4 CONSTRUCTION NOISE MONITORING

4.1 MONITORING REQUIREMENTS

- 4.1.1 Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (Leq). Leq_{30min} shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. For all other time periods, Leq_{5min} shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. As supplementary information for data auditing, statistical results such as L₁₀ and L₉₀ shall also be obtained for reference.
- 4.1.2 In case of non-compliance with the construction noise criteria, more frequent monitoring as specified in the Event and Action Plan shall be carried out. This additional monitoring shall be continued until the recorded noise levels are rectified or proved to be irrelevant to the construction activities.

4.2 MONITORING PARAMETER, FREQUENCY AND DURATION

4.2.1 During normal construction working hour (0700-1900 Monday to Saturday), monitoring of L_{eq30min} noise levels (as 6 consecutive L_{eq5min} readings) shall be carried out at the designated monitoring location NM1- Ha Pak Nai once every week.

4.3 MONITORING LOCATIONS

4.3.1 According to the updated EM&A Manual, the ET shall carry out noise monitoring during the construction phase at the designated monitoring station as shown in *Table 4-1* and illustrated in *Appendix D*.

Table 4-1 Construction Noise Monitoring Station

Monitoring ID	EIA NSR Ref	Location	Type of Monitoring	0	Supplementary Information
NM1		Village house at Ha Pak Nai		30mins and or 5mins of L _{Aeq}	L _{A10} and L _{A90}

4.4 MONITORING EQUIPMENT

- 4.4.1 As referred to in the Technical Memorandum (TM) issued under the NCO, sound level meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications were used for carrying out the noise monitoring. Immediately prior to and following each noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements would be accepted as valid only if the calibration level from before and after the noise measurement agrees to within 1.0 dB.
- 4.4.2 Noise measurements were made in accordance with standard acoustical principles and practices in relation to weather conditions. Weather information such as wind speed and wind direction would be extracted from Lau Fau Shan weather station during the impact monitoring.
- 4.4.3 The ET was responsible for the provision, installation, operation, maintenance, dismantle of the monitoring equipment. Sufficient noise measuring equipment and associated instrumentation are available for carrying out the impact monitoring. The equipment and associated instrumentation have been clearly labelled.



4.4.4 Noise monitoring equipment used for impact monitoring is listed in *Table 4-2*.

Table 4-2 Noise Monitoring Equipment

Equipment	Model	Serial No.
Integrating Sound Level Meter	Rion NL-52 / B&K2238	00921191 / 2285722
Calibrator	B&K 4231	2713428

4.4.5 Sound level meter listed above comply with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications, as recommended in Technical Memorandum (TM) issued under the Noise Control Ordinance (NCO), which was used for impact noise monitoring. The copies of calibration certificates of noise monitoring equipment were shown in *Appendix E2*.

4.5 MONITORING PROCEDURES

- 4.5.1 The microphone of the sound level meter was set at a height of about 1.5m subject to site condition and oriented pointed to the site, with the microphone facing perpendicular to the line of sight. Moreover, the microphone was positioned away from any reflective surface, and a correction of +3 dB(A) has been made for the free field measurements.
- 4.5.2 Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. The calibration level from before and after the noise measurement agrees to within 1.0dB.
- 4.5.3 Leq $_{30 min}$ shall be taken as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. After the measurement, the data were recorded and stored automatically within the sound level meter system. At the end of the monitoring period, noise levels in term of L_{eq} , L_{90} and L_{10} were recorded.
- 4.5.4 All the monitoring data stored in the sound level meter system were downloaded through the computer software, and all these data were checked and reviewed on computer.

4.6 ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE

4.6.1 Following the guidelines for establishing the Action and Limit Levels for construction noise monitoring, the Action and Limit Levels are presented in *Table 4-3*. Should project-related non-compliance of the environmental quality criteria occur, remedial actions will be triggered according to the Event and Action Plan which is presented in *Appendix G*.

Table 4-3 Action and Limit Levels for Construction Noise

Monitoring Location	Action Level	Limit Level in dB(A)	
Wiomtoring Location	Time Period: 0700-1900 hours on normal weekdays		
NM1	When one or more documented complaints are received	75 dB(A)	
Note: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.			

4.7 Noise Monitoring Results

- 4.7.1 The monitoring schedule is presented in Appendix H and the monitoring results are summarized in the following sub-sections.
- 4.7.2 In the Reporting Period, 5 sessions of noise measurements were carried out at designated monitoring station NM1. The noise monitoring results are summarized in *Table 4-4*. The



detailed noise monitoring data are presented in Appendix I and the relevant graphical plots are shown in Appendix J.

Table 4-4 Summary of Construction Noise Monitoring Results

	Construction Noise Level (Leq30min), dB(A)					
Station ID	Description of location	Range	No. of Sessions	Action Level	Limit Level	
NM1	Village house at Ha Pak Nai	51 - 60	5	When one documented complaint is received at anytime during the construction period	75	

Remarks

- (*) Noise measurements was conducted at free field condition and façade correction (+3 dB(A) was added according to acoustical principles and EPD guidelines
- 4.7.3 As shown in *Table 4-4*, no construction noise measurement results triggered the Limit Level (75 dB(A)) in the Reporting Month. Due to the construction programme, construction works during restricted hour was commenced from 15 November 2024. According to site inspection and auditing on Contractor's record have shown that the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority for construction works during restricted hours were followed. Thus, the stipulated requirement on noise impact control during restricted hour was achieved.
- 4.7.4 Furthermore, no valid noise complaint (which triggered Action Level exceedance) was recorded in the Reporting Period.



5 WATER QUALITY MONITORING

5.1 MONITORING REQUIREMENTS

- 5.1.1 According to the updated EM&A Manual, the Contractor shall carry out surface water monitoring from the commencement of the works until the issue of the Aftercare Certificate.
- 5.1.2 According to general water quality monitoring criteria, water sampling depth should be:
 - If the water depth during sampling is exceeded 6m, three depths: 1m below water surface, 1m above river/stream bed and mid-depth.
 - If the water depth during sampling is exceeded 3m but less than 6m, two depths: 1m below water surface and 1m above river/stream bed.
 - If the water depth is less than 3m, one depth: perform at mid-depth.
- 5.1.3 Duplicate samples and repeat in-situ measurement shall be taken from each sampling depth.

5.2 MONITORING FREQUENCY AND DURATION

5.2.1 During the construction phase, monthly monitoring of the surface water discharges shall be carried out in order to show if contamination of surface water by leachate is occurring.

5.3 Monitoring Locations

5.3.1 The surface water monitoring should be carried out at the specified point WM1 in accordance with Figure 5.1 in the updated EM&A Manual, which is shown in *Appendix D*, unless otherwise agreed by IEC and approved by the SM.

5.4 ANALYSIS PARAMETERS

- 5.4.1 According to Section 5.5 of the updated EM&A Manual, the parameters of surface water monitoring included in-situ measurement and laboratory analysis are listed below.
 - A. <u>In-situ measurement:</u>

Temperature (°C), pH (unit), Salinity (ppt), Turbidity (NTU), Dissolved Oxygen (DO) (mg/L) & Dissolved Oxygen Saturation (DOS) (%), Electrical Conductivity (μ S/cm), Water Flow direction (degree) / speed (m/s) and Water depth (m).

B. Laboratory Analysis (mg/L):

Alkalinity, Chemical Oxygen Demand (COD), 5-day Biochemical Oxygen Demand (BOD₅), Total Organic Carbon (TOC), Suspended Solids (SS), Ammonia Nitrogen (NH₃-N), Total kjeldahl nitrogen, Nitrate (NO₃), Sulphate & Sulphite, Phosphate, Chloride and Oil & Grease.

C. Laboratory Analysis:

Sodium (µg/L) and Coliform Count (cfu/100mL).

D. Heavy Metals Analysis (µg/L):

Magnesium (Mg), Calcium (Ca), Potassium (K), Iron (Fe), Nickel (Ni), Zinc (Zn), Manganese (Mn), Copper (Cu), Lead (Pb) and Cadmium (Cd).

5.5 MONITORING EQUIPMENT

5.5.1 Water quality monitoring equipment used for impact monitoring is listed in *Table 5-1*.

Table 5-1 Surface Water Monitoring Instrument

Equipment	Model	Serial No.
A Digital Global Positioning System	Garmin eTrex	N/A
Thermometer & DO meter	YSI Professional DSS Multifunctional Meter	[20J101862/15H103928]/ [EQW018]



Equipment	Model	Serial No.
pH meter		
Turbidimeter		
Salinometer		
Conductivity meter		
Current Meter	Valeport Model 106 Current	[60011]
Current Meter	Meter	
Sample Container	High density polythene bottles	N/A
Sample Container	provided by laboratory	
Storage Container	'Willow' 33-liter plastic cool box	N/A
Storage Container	with ice pad	

5.5.2 All in-situ measurement instruments such as DO measuring instruments, turbidity measuring instruments, salinometer and A portable pH meter, would be calibrated by HOKLAS accredited laboratory at three-month intervals. Valid calibration certificate is attached in *Appendix E3*

5.6 LABORATORY ANALYSIS

5.6.1 A local HOKLAS-accredited laboratory (ALS Technichem (HK) Pty Ltd HOKLAS registration number: HOKLAS 066) was appointed as a testing laboratory to carry out chemical analytical. The HOKLAS accredited certificate of laboratory is shown in *Appendix E3*. The determination was started within 24 hours or recommended hold time of collection of water samples. The method of chemicals analysis is shown below *Table 5-2*.

Table 5-2 Test Method and Reporting Limit of Chemicals Analysis

Analyte Description	ALS Method Code	Method Reference	Limit of Reporting (LOR)
pH value @25°C	EA002	APHA 4500 H: B	0.1 pH Unit
Conductivity @25°C	EA010	APHA 2510 B	1μS/cm
Suspended Solids	EA025-LL**	APHA 2540 D	0.1mg/L
Total Alkalinity as CaCO ₃	ED037	APHA 4500 H: B	1mg/L
Sulphate as SO ₄	ED041K	USEPA 375.4	1mg/L
Chloride	ED045K	USEPA 325.1	0.5mg/L
Cadmium			0.2μg/L
Copper			1μg/L
Lead	EG020 T	USEPA 6020	1μg/L
Manganese	EG020 1	USEFA 0020	1μg/L
Nickel			1μg/L
Zinc			10μg/L
Calcium			50μg/L
Iron			10μg/L
Magnesium	EG032 T	USEPA 6010	50μg/L
Potassium			50μg/L
Sodium			50μg/L
Ammonia as N	EK055K	APHA 4500 NH3 G	0.01mg/L
Nitrate as N	EK058A	APHA 4500 NO3: I	0.01mg/L
Total Kjeldahl Nitrogen as N	EK061A	APHA 4500 Norg: D; USEPA 1688	0.1mg/L
Reactive Phosphorus as P	EK071K	APHA 4500 P: B & F	0.01mg/L
Sulphite as SO ₃ ²⁻	EK086 **	APHA 4500 SO3: B	2mg/L
Total Organic Carbon	EP005	APHA 5310 B	1mg/L
Oil and Grease	EP020	APHA 5520 B	5mg/L
Chemical Oxygen Demand	EP026C	APHA 5220 C	5mg/L



Analyte Description	ALS Method Code	Method Reference	Limit of Reporting (LOR)
(COD) (Closed Reflux method)			
Biochemical Oxygen Demand (BOD)	EP030	APHA 5210 B	2mg/L
Total Coliforms	EM003	DoE section 7.8, 7.9.4.1 & 3	1 CFU/100mL

Remarks: Except ** Item, all the methods as quoted is HOKLAS accredited

5.7 MONITORING PROCEDURES

- 5.7.1 Prior to conducting in-situ measurement and water sampling, general information such as the sampling date, time, weather conditions and the personnel responsible for the monitoring would be recorded on the field data sheet. The location of water quality monitoring station was confirmed using GPS prior to in-situ monitoring and sampling. Moreover, the water depth at the monitoring station will be measured using a portable digital global positioning system.
- 5.7.2 In order to collect sufficient impact data, surface water monitoring will be conducted at two specific tide points: one mid-ebb and one mid-flood.
- 5.7.3 Before the surface water sampling, water flow and direction would be measured by Valeport Current Meter. Moreover, water temperature, DO & DOs, pH, salinity, conductivity and turbidity were taken by YSI Professional DSS Multifunctional Meter. These measurement results would be downloaded from instruments and recorded.
- 5.7.4 As the water depth was less than 3m, in-situ measurement and water sampling was conducted at mid-depth only. Water samples were collected repeatedly using the water sampler to obtain adequate water volumes for laboratory analysis. All the obtained water volumes would be directly filling into sample container as provided by the testing laboratory. Also, sample container would be pre-labeled with date, location, tide, depth, parameters and replicate information of the sample. The water sampler would be rinsed using local marine water before it used to collect marine water sample. Container is sealed with a screw cap after completed water filling then packed in cool box (maintain 4°C without being frozen) and delivered to the laboratory on the same day of sample collection for analysis. Also, the water sample filled into container until no remaining air space and then the lid securely screwed on. Where samples are to be preserved with acid or alkalis prior to transport to the laboratory, the sample bottles would be filled to the specified level which advised by the testing laboratory.
- 5.7.5 Before each round of monitoring, the dissolved oxygen probe would be calibrated by wet bulb method; a zero check in distilled water would be performed with the turbidity and salinity probes; 4 and 10 values of the standard solution would be undertaken to check the accuracy of pH value.
- 5.7.6 Additionally, the laboratory will retain all water samples after analysis for a period of 3 months, allowing for the possibility of repeat analysis if needed.

5.8 DATA MANAGEMENT AND QUALITY ASSURANCE (QA)/QUALITY CONTROL (QC)

5.8.1 All monitoring data would be handled by AUES's in-house data recording and management system. The monitoring data recorded in the equipment would be downloaded directly from the equipment at the end of each monitoring day and input into a computerized database maintained by the AUES. The laboratory results would be input directly into the computerized database and checked by personnel other than those who input the data.



5.8.2 For monitoring parameters that require laboratory analysis, the testing laboratory would be according with the QA/QC requirements as set out under the HOKLAS scheme for the relevant laboratory tests.

Action/Limit Levels for Surface Water Quality

5.8.3 Following above guidelines for establishing the Action and Limit Levels for surface water quality monitoring, the Action and Limit Levels of the Project are presented in *Table 5-3*.

Table 5-3 Action and Limit Levels for Surface Water Monitoring during Construction Phase

Monitoring Parameter	Action Level	Limit Level
DO mg L ⁻¹	6.4	4.0
pH, (unit)	Beyond the range of 6.5 to 8.5	Beyond the range of 6 to 9
Turbidity, NTU	23.4	34.1
SS, mg L ⁻¹	47.3	50.0

5.9 RESULTS OF SURFACE WATER QUALITY MONITORING

- 5.9.1 The monitoring schedule is presented in Appendix H and the monitoring results are summarized in the below sections.
- 5.9.2 Surface water quality monitoring was carried out at the designated monitoring station WM1 on 16th July 2025. As the water depth at WM1 was less than 3m, in-situ measurement and water sample collection were conducted at mid-depth.
- 5.9.3 There are no exceedances recorded for surface water monitoring. The monitoring results including in-situ measurement and laboratory analysis are shown in Appendix I and the relevant graphical plots are shown in Appendix J.



6 ECOLOGY MONITORING

6.1 REQUIREMENTS

- 6.1.1 The EIA stipulated that ecological monitoring should be undertaken throughout the design, construction, operation, restoration and aftercare phases of WENT Landfill Extension to ensure that all mitigation measures should be fully complied with. The objectives of design audit for ecology are to ensure that the design for ecological mitigation specified in the EIA Report will be conducted to ensure that such designs are ecologically feasible and effective.
- 6.1.2 The performance of monitoring and audit from an ecological prospective should be integrated with the overall monitoring and audit plan for the project as a whole. The information on the commencement and programme of the engineering works should enable the ecological monitoring to be prepared with considerations of seasonality factors. An EMIS of the recommended mitigation measures is presented in *Appendix* M.

6.2 ECOLOGICAL MITIGATION MEASURES

6.2.1 Ecological mitigation measures to be implemented before commencement of relevant construction phase should include survey and transplantation of plant species of conservation interest and setting up water quality monitoring stations inside Tai Shui Hang catchment to monitor the conditions of the habitat for the rare freshwater fish, *Acrossocheilus parallens*. In addition, although potential impacts to stream loss and fish species of conservation interest are ranked as minor and insignificant and no mitigation is required, a precautionary measure – fish capture and translocation survey for the three fish species of conservation interest including *Squaliobarbus curriculus*, *Osteochilus vittatus* and *Kuhlia marginata* will also be implemented before site clearance.

6.3 MONITORING AND AUDIT FOR ECOLOGY

- 6.3.1 The ecological monitoring and audit programme in relation to construction phase would be survey and transplantation of the plant species of conservation interest and 2 years of monitoring after.
- 6.3.2 According to the EIA Report, four plant species of conservation interest were found and directly impacted by the WENT Landfill Extension in June 2009. However, during the latest field survey in January 2024, only three groups of *Nepenthes mirabilis* (Pitcher Plant) could be found, and the remaining mentioned plants were not located. For *Ixonanthes reticulata* recorded at Tsang Kok Stream from the VEP were not found during the survey in January 2024. If *Ixonanthes reticulata* is found in the future, further assessment will be carried out to review the feasibility of transplantation.
- 6.3.3 Upon completion of transplantation, monitoring should be implemented for 2 years. The health and condition of individuals of the transplanted plant species of conservation interest should be monitored during the first 2 years after transplantation. Monitoring should be conducted monthly during first 6 months, and bi-monthly in the next 18 month to ensure survival. Since die-back of current year's growth is not uncommon, new stems, leaves and/or flowers produced from the cuttings in the following years, if observed in the following season, should be marked separately but also counted as survived individuals.
- 6.3.4 Monitoring of transplanted species will be carried out after the transplantation work. No monitoring is required in the Reporting Period.
- 6.3.5 The CLP 132 kV cable will be constructed for the power supply of the permanent crushing plant at Portion A1. Therefore, the ecological study for the alignment of 132kV cable had been carried out and concluded that no adverse impact will be caused for the 132kV cable



construction. The habitat map with photo record is shown in Appendix P.



7 LANDSCAPE AND VISUAL MONITORING

7.1 MONITORING REQUIREMENTS

- 7.1.1 The EIA study has recommended landscape and visual mitigation measures to be undertaken during the construction and operation phases, as well as the restoration and aftercare phases of the project. Compared with the approved WENTX EIA, two new visual sensitive receivers (VSRs) within the visual envelop from the boundary of the Project are identified. Other VSRs are the same as the EIA. This section outlines the EM&A requirements of these measures to mitigate the landscape and visual impacts. An EMIS of the recommended mitigation measures is presented in *Appendix M*.
- 7.1.2 Measures to mitigate the landscape and visual impacts during the construction and operation phases should be checked to ensure compliance with the intended aims of the measures. The progress of the engineering works should be regularly reviewed on site to identify the earliest practical opportunities for the landscape works to be undertaken. The event and action plan for landscape and visual monitoring during the construction phase is summarised in *Appendix G*.

7.2 MONITORING AND OBSERVATION

7.2.1 In order to monitor the landscape and visual impact after providing mitigation measures effectively, all the specified and affected landscape character areas, landscape resources and visually sensitive receivers should be monitored. Implementation of mitigation measures during construction phase of the Project has been monitored through regular site inspection/ audit.



8 LANDFILL GAS MONITORING

8.1 REQUIREMENT

8.1.1 Landfill gas (LFG) monitoring should commence at the start of specific construction works, such as excavation and drilling for blasting, and through the operation, restoration and until completion of aftercare phases. The measured LFG results should be checked for compliance against pre-defined A/L Levels in this EM&A Manual. In case exceedance of compliance level was detected at any locations, the EAP should be triggered for necessary action to be taken.

8.2 MONITORING PARAMETERS

A suite of LFG monitoring parameters include:

Monitoring	Monitoring Parameters	Requirement of Monitoring
Method		
 Monitoring 	Methane (CH ₄), carbon dioxide	If the blasting works are within the 250m
borehole:	(CO ₂), oxygen (O ₂), flammable	consultation zone of WENT Landfill, gas
	gas	monitoring shall be conducted at the
		nearest monitoring boreholes(#).
Surface gas	CH_4 , CO_2 , O_2	For excavation works between 300mm
location:		and 1m deep and deeper than 1m; and
		throughout the whole process of the
		blasting
• Gas well head:	CH ₄ , CO ₂ , O ₂ , flammable gas,	Once the gas well(#) is set up
	volatile organic compounds	
	(VOC)	
Off-site	VOC	Once WENTX starts receiving waste
location:		

Remark: (#) Monitoring boreholes will be installed for LFG monitoring at the borehole and gas well head. The programme for borehole installation will be synchronized with the construction programme.

8.2.1 The existing WENT Landfill is required to conduct LFG monitoring during landfill operation from drillholes, boreholes, gas probes and piezometers around the perimeter of the Site as specified in their contract. Before setting up the monitoring boreholes for WENTX, the Contractor should refer to the monitoring data collected from the existing WENT Landfill. This data serves as a reference and provides valuable information regarding historical gas levels and trends at the site.

8.3 MONITORING EQUIPMENT

Monitoring for Construction Works

- 8.3.1 Intrinsically safe portable gas detectors should be used during excavation or when working in any confined spaces, which have the potential for presence of LFG and risk of explosion or asphyxiation. The monitoring equipment should alarm, both audibly and visually, when the concentrations of the following gases were exceeded:
 - CH₄: > 10% of the Lower Explosion Limit (LEL);
 - CO_2 : > 0.5% by volume; and
 - O_2 : < 19% by volume

Calibration and Maintenance

8.3.2 All portable instrument should be calibrated and serviced according to the manufacturer's instructions. Calibration gases should be used for checking portable instrument for methane and carbon dioxide detection before and after use. Instrument for monitoring oxygen should



be calibrated against normal expected air concentrations. Any significant variations in instrument performance outside that expected through normal drift should be noted with the instrument calibration timely corrected.

8.3.3 Gas analyser was used for carrying out LFG monitoring for Construction Works. **Table 8-1** summarises the equipment that were used in the LFG monitoring programme and the calibration certificates are shown in *Appendix E4*.

Table 8-1 LFG Monitoring Equipment

Monitoring Parameter	Equipment	Model	Serial No.
CH ₄ , CO ₂ & O ₂	Gas Analyser	SKY3000-R5	02100C44A2002
		GEM5000	G510348

8.4 MONITORING LOCATIONS

- 8.4.1 During the construction stage, when excavation of 1m deep or more, surface LFG concentrations should be monitored at before entry and periodically during the progress of works.
- 8.4.2 The blasting work is scheduled to be carried out in 6 Phases and during Phase 1, the Contractor will utilise the existing WENT's monitoring wells for carrying out landfill gas monitoring as the WENTX landfill gas monitoring boreholes have yet to be completed. However, the Contractor is committed to complete the proposed landfill gas monitoring boreholes along the WENTX waste boundary for both Phase 1 and 2 blasting areas while Phase 1 blasting work is being carried out and so on for subsequent phases. In other words, when the blasting work is completed for Phase 1, the landfill gas monitoring boreholes for subsequent phase (i.e. Phase 2) is also complete and likewise for subsequent Phases. After Phase 1 blasting work is completed, WENT's monitoring wells will no longer be needed as the next phase proposed monitoring wells would have already been constructed. The landfill gas monitoring will be carried out in accordance with the requirement either within 250m consultation zone of the WENT Landfill or within 250m from the waste boundary of the WENT landfill extension site.

8.5 MONITORING FREQUENCY

- 8.5.1 The monitoring frequency and areas to be monitored should be set down prior to commencement of groundworks either by the Registered Safety Officer or by an appropriately qualified person. Routine monitoring should be carried out the in slope cutting by blasting, in all excavations, manholes and chambers and any other confined spaces that may have been created by, for example, the temporary storage of building materials on the site surface. All measurements in excavations should be made with the monitoring tube located not more than 10mm from the exposed ground surface.
- 8.5.2 The Contractor will maintain close liaison with WENT Landfill operator on a weekly basis and provide a two weeks tentative blast schedule at least 1 week before the blasting work. The tentative blast schedule will include the schedule blast date, location of blast works and the approximate separation distance between the blast area and existing WENT Landfill boundary.
- 8.5.3 The frequency and the locations of the LFG monitoring within the excavation area should be determined prior to commencement of the blasting works. The monitoring requirements and procedures specified in *Paragraphs 8.23 to 8.28 of the EPD's Landfill Gas Hazard Assessment Guidance Note* shall be strictly followed.
 - A. For blasting works on existing slope



The Contractor will perform landfill gas monitoring for all blasting works within the 250m consultation zone of the WENT Landfill (i.e. plan distance from the edge of the existing waste boundary of WENT Landfill site) at the schedule below.

- The Contractor will inform WENT Landfill operator about the selected perimeter monitoring wells along WENT's landfill boundary for landfill gas monitoring that may be required. When existing WENT's monitoring wells are proposed, permission from WENT's Landfill operator must be obtained.
- The Contractor will carry out landfill gas monitoring at the nearest monitoring wells (within 250m from WENT boundary) and the results shall be reported to the Service Manager. If the methane concentration is measured and remained to be less than 1%, drilling of blast holes can be proceeded after receiving confirmation from the Service Manager.
- Drilling of blast holes will take multiple days, thus, landfill gas monitoring shall be carried out every morning at the nearest blast hole following the same procedure as mentioned above prior to resume drilling work.
- i) Surface Emission Monitoring
 - a walkover survey for surface gas emission to be undertaken within the blasting area, with a portable gas measuring probe to detect the air condition at about 10 millimeters above the ground level to ensure no LFG is present.

B. For excavation works deeper than 1m

- i) Measurements should be made:
 - at ground surface before excavation work commences;
 - immediately before any worker enters the excavation;
 - at the beginning of each working day for the entire period the excavation remains open; and
 - periodically through the working day whilst workers are in the excavation.

C. For excavation between 300mm and 1m deep

- i) Measurements should be made:
 - directly after the excavation has been completed; and
 - periodically whilst the excavation remains open.
- 8.5.4 For excavations less than 300mm deep, monitoring may be omitted, at the discretion of the Safety Officer or other appropriately qualified person.
- 8.5.5 During the construction (specific construction works) operation, restoration and until completion of aftercare phases, LFG monitoring should be conducted in monthly basis at designated monitoring locations and gas monitoring boreholes, supplemented by monthly site surveys of the surrounding environment including natural cracks and fissures, service drains and ducts, area with sign of vegetation death, and any below ground enclosed spaces. If the monitoring results indicate evidence of gas migration, the monitoring frequency should be increased accordingly, with the implementation of appropriate mitigation measures under the EAP.
- 8.5.6 The monitoring frequency should be reviewed throughout the on-going development of WENT Landfill Extension and revised as necessary based on the LFG monitoring data.

8.6 A/L LEVELS AND EVENT ACTION PLAN

8.6.1 The A/L Levels and relevant EAP for LFG detected in excavation, utilities and enclosed onsite



areas are summarised in Table 8-1.

Table 8-1 A/L Levels and EAP for LFG

Parameter	Level	Action	
Oxygen (O ₂)	Action Level <19% O ₂	• Ventilate trench/void to restore O ₂ to >19%	
	Limit Level <18% O ₂	Stop works Evacuate personnel/prohibit entry Increase ventilation to restore O ₂ to >19%	
Methane (CH ₄)	Action Level >10% LEL*	Prohibit hot works Increase ventilation to restore CH ₄ to <10% LEL	
	Limit Level >20% LEL	 Stop works Evacuate personnel/prohibit entry Increase ventilation to restore CH₄ to <10% LEL 	
Carbon dioxide (CO ₂)	Action Level** >0.5%** CO ₂	Ventilate to restore CO ₂ to < 0.5%	
	Limit Level >1.5% CO ₂	 Stop works Evacuate personnel / prohibit entry Increase ventilation to restore CO₂ to <0.5% 	

^{*} LEL: Lower Explosive Limit – concentrations in air below which there is not enough fuel to continue an explosion.

8.7 MONITORING RESULTS

- 8.7.1 The LFG monitoring was conducted for excavation work in July 2025. The LFG monitoring results are summarized in *Appendix I*.
- 8.7.2 No exceedance of Limit Levels of LFG was recorded during the Reporting Period.
- 8.7.3 No effect that arose from the other special phenomena and work progress of the concerned site was noted during the current monitoring month.

^{**} This Action Level of CO₂ at 0.5% is set for reference only, assuming no CO₂ emission from a particular location. Depending on the baseline CO₂ levels, the Action Level at a particular location will be changed.



9 WASTE MANAGEMENT

9.1 GENERAL WASTE MANAGEMENT

9.1.1 Waste management was carried out in accordance with the Waste Management Plan for the Contract.

9.2 RECORDS OF WASTE QUANTITIES

- 9.2.1 All types of waste arising from the construction work are broadly classified into the following:
 - Inert construction & demolition (C&D) Material; and
 - Non-inert C&D waste
- 9.2.2 The Contractor is advised to minimise the wastes generated through recycling or reusing. All mitigation measures stipulated in the updated EM&A Manual and waste management plans shall be fully implemented.
- 9.2.3 The quantities of waste for disposal of in this Reporting Period are summarized in *Tables 9-1* and *9-2* and they are made reference to the Waste Flow Table provide by the Contractor which shown in *Appendix K*.

Table 9-1 Summary of Quantities of Inert C&D Materials

Type of Waste	Quantity
Total generated C&D Materials (Inert) (in '000m ³)	14.730
Reused in this Contract (Inert) (in '000m ³)	3.962
Reused in other Projects (Inert) (in '000m ³)	10.768
Disposal as Public Fill (Inert) (in '000m ³)	0

Table 9-2 Summary of Quantities of Non-inert C&D Wastes

Type of Waste	Quantity
Recycled Metals (in kg)	0.100
Recycled Paper / Cardboard Packaging (in kg)	1.700
Recycled Plastics (in kg)	2.100
Chemical Waste (in liter)	0
Chemical Waste (in '000kg)	0
Yard Waste (in tonne)	20.610
General Refuse (in '000m ³)	0.231



10 SITE INSPECTION

10.1 REQUIREMENTS

10.1.1 According to the updated EM&A Manual, the programme of environmental site inspection shall be formulation by ET Leader. Weekly environmental site inspections were carried out to confirm the environmental performance.

10.2 FINDINGS / DEFICIENCIES DURING THE REPORTING PERIOD

- 10.2.1 In the Reporting Period, joint site inspections to evaluate the site environmental performance for the Project were carried out by the representatives of the SM, ET and the Contractor on 3rd, 10th, 17th, 24th and 31st July 2025. In addition, IEC carried out the joint site inspection on 10th July 2025. No non-compliance was noted.
- 10.2.2 The findings / deficiencies observed during the weekly site inspection are listed in *Table 10-1*.

Table 10-1 Site Inspection and Observations

Table 10-1 Site Inspection and Observations			
Date	Findings / Deficiencies	Follow-Up Status	
3 th July 2025	Mosquito breeding control measures should be provided. (Portion C1)	Larvidcide was used for mosquito control measure.	
	• Chemical stain on ground should be treated properly. (Portion B9)	Chemical stain was cleaned.	
	 Chemical containers should be placed inside drip tray to avoid any land contamination. (Portion B9 & A1) 	• The chemical container was removed.	
	• Submersible pump should be provided for the drainage channel to divert the runoff to wastewater treatment facilities. (Portion B9)	Pump was provided.	
	• Maintenance work for the excavator should be carried out to avoid oil leakage. (Portion A1)	Oil leakage was fixed.	
	• Sand bag bund at boundary of work area should be enhanced. (Portion B9)	More sand bags were placed.	
	 Acoustic material for breaker should be replaced. (Portion A1) 	Acoustic material was replaced.	
	• Sediment accumulated at the nullah should be removed. (Portion A1)	Sediment removal is ongoing.	
10 th July 2025	• Soil and mud cumulated at public road should be cleaned. (Portion C1)	Soil and mud cumulated at public road were cleaned.	
	• Stagnant water cumulated inside the drip tray should be cleaned. (Portion C1)	Stagnant water was cleaned.	
	• Oil stain leakage on ground should be cleaned. (Portion B10)	Oil stain was cleaned.	



	in Monitoring & Munit Report Sury 2025		
17 th July 2025	• Earth bund should be provided at site boundary to prevent site surface runoff flushing into the public area. (Portion C1)	•	More sand bags were placed.
	• Oil leakage from breaker head should be cleaned. (Portion C1 & B8)	•	Oil stain was cleaned.
	• Proper dust mitigation measures should be provided for haul road and exposed area to reduce dust generation. (Portion A1)	•	Watering was provided.
	• It was reminded that slurry cumulated inside the drainage should be cleaned before typhoon to maintain the design capacity of TDMP. (Portion B1a & B10)	•	Noted.
24 th July 2025	Broken drip tray should be replaced. (Portion C1)	•	Broken drip tray had been replaced.
	• NRMM label should be displayed properly for NRMM using on-site. (Portion C1)	•	NRMM label was displayed properly.
	• Drip tray should be provided for chemical storage on-site. (Portion B9, B10, A1)	•	Drip trays were provided.
	Three side plus top shelter should be provided for cement mixing area. (Portion A1)	•	Three side plus top shelter had been setup.
	• Stockpile of bag cement should be covered with tarpaulin sheet when storage on-site. (Portion A1)	•	Tarpaulin sheet had been provided.
	• It was reminded that stagnant water cumulated on- site after rainstorm should be cleaned. (Portion C1)	•	Noted.
31st July 2025	• Stagnant water should be removed to prevent mosquito breeding. (Portion C1 and Portion B10)	•	Stagnant water was cleaned.
	• Drip tray should be provided for chemical storage onsite. (Portion C1)	•	Chemical was removed.
	• Acoustic material should be provided for breaker to minimise noise impact. (Portion C1)	•	Acoustic material was provided.

10.2.3 General housekeeping such as site tidiness and cleanliness should be maintained for all works areas. Furthermore, the Contractor was reminded to implement the Waste Management Plan of the Contract.



11 ENVIRONMENTAL COMPLAINTS AND NON-COMPLIANCES

11.1 Environmental Complaints, Summons and Prosecutions

- 11.1.1 There was no environmental complaint, prosecution or notification of summons received in the Reporting Period.
- 11.1.2 The statistical summary table of the environmental complaints, summons and prosecutions are presented in *Tables 11-1*, *11-2* and *11-3*. The complaint log for the Project is presented in *Appendix L*.

Table 11-1 Statistical Summary of Environmental Complaints

Depositing Devied	Enviro	vironmental Complaint Statistics				
Reporting Period	Frequency	Cumulative	Complaint Nature			
3 rd April 2024 – 30 th June 2025	1	1	Air			
1 st – 31 st July 2025	0	1	NA			

Table 11-2 Statistical Summary of Environmental Summons

Donouting Davied	Environmental Summons Statistics						
Reporting Period	Frequency	Cumulative	Summons Nature				
3 rd April 2024 – 30 th June 2025	0	0	NA				
1 st – 31 st July 2025	0	0	NA				

Table 11-3 Statistical Summary of Environmental Prosecution

Donauting Davied	Environmental Prosecution Statistics						
Reporting Period	Frequency	Cumulative	Prosecution Nature				
3 rd April 2024 – 30 th June 2025	0	0	NA				
1 st – 31 st July 2025	0	0	NA				

11.2 OTHER ENVIRONMENTAL NON-COMPLIANCES

11.2.1 In addition, no emergency events related to violation of environmental legislation for illegal dumping and landfilling were received in the Reporting Period.



12 IMPLEMENTATION STATUS OF MITIGATION MEASURES

12.1 GENERAL REQUIREMENTS

- 12.1.1 The environmental mitigation measures that recommended in the EMIS in the EM&A Manual covered the issues of dust, noise, water and waste etc. and they are summarised presented in *Appendix M*.
- 12.1.2 The works under the Project shall be implementing the required environmental mitigation measures according to the EM&A Manual as subject to the site condition. Environmental mitigation measures generally implemented by the Contractor and the implementation status are shown in *Appendix M*.

12.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH

12.2.1 According to information provided by the Contractor, the construction works under the Project in the next month are listed below:

Portion A1, B1a, B1c & B6

- Soft excavation
- Hard excavation
- Blasting
- DCM works
- 132kV substation construction

Portion B10

• Leachate Treatment Works & Landfill Gas Treatment Plant

Portion C1

- External manholes construction
- Temporary drainage diversion at nullah
- Construction of new haul road

Portion B2 & B9

- J-Channel Construction
- Pilling Works
- DCM & DJM Works

Portion D1

• Pipe Laying Works

Portion D4 & B5

• Maintenance Dredging

Portion F

• Rock Crushing

12.3 Key Issues for the Coming Month

- 12.3.1 Key issues for the coming month include the following:
 - Implementation of control measures for rainstorm / adverse weather;
 - Regular clearance of stagnant water;
 - Implementation of dust suppression measures at all times;
 - Implementation of permanent/temporary drainage system and control measures for the surface runoff;



- Implementation of dust suppression measures for the dry/loose/exposure soil surface/dusty material;
- Implementation of control measures to avoid disposal of empty engine oil containers within site area;
- Ensure dust suppression measures are implemented properly;
- Regular maintenance of sediment catch-pits and silt removal facilities;
- Management of chemical wastes;
- Implementation of control measures to avoid discharge of site effluent to the nearby stream;
- Implementation of waste management; and
- Implementation of construction noise preventative control measures.



14 CONCLUSIONS AND RECOMMENDATIONS

14.1 CONCLUSIONS

- 14.1.1 This is the 16th Monthly EM&A Report presenting the monitoring results and inspection findings for the Project for the period from 1st to 31st July 2025.
- 14.1.2 In this Reporting Period, no 1-hour and 24-hour TSP of air quality monitoring result that triggered the Action or Limit Levels was recorded. No corrective action was required.
- 14.1.3 In this Reporting Period, no noise complaint (which is an Action Level exceedance) was received and no construction noise measurement result triggered the Limit Level was recorded in this Reporting Month. Moreover, all construction works during restricted hours were followed the CNP requirement. Therefore, no corrective action was issued.
- 14.1.4 In this Reporting Period, no surface water quality monitoring result that triggered the Action or Limit Levels was recorded. No corrective action was required.
- 14.1.5 The LFG monitoring was conducted for excavation work in June 2025. No exceedance of Limit Levels of LFG was recorded during the reporting period.
- 14.1.6 For landscape and visual, implementation of mitigation measures during construction phase of the Project has been monitored through regular site inspection/ audit. During 3rd CLG meeting, Lung Kwun Tan village representative raised an issue about landscape and visual along the northwest boundary in adjacent to Nim Wan Road, the issue had been followed up and replied to the village representative.
- 14.1.7 In the Reporting Period, no environmental complaint, summons and prosecution was received. In addition, no emergency events related to violation of environmental legislation for illegal dumping and landfilling were received.
- 14.1.8 In the Reporting Period, weekly joint site inspection to evaluate the site environmental performance had been carried out by the representatives of the SM, ET and the Contractor. No non-compliance was noted during the site inspection. In addition, IEC carried out the joint site inspections on 10th July 2025.

14.2 **RECOMMENDATIONS**


- 14.2.1 Water quality mitigation measures shall be fully implemented in accordance with the Implementation Schedule for Environmental Mitigation Measures of the updated EM&A Manual.
- 14.2.2 In addition, the Contractor should fully implement the recommended air quality mitigation measures to minimize the impact of construction dust as far as practicable.
- 14.2.3 Construction noise would be a key environmental issue during construction work of the Project. In accordance with the EP, a noise bund of 3.5m tall has been constructed along the north eastern seafront of the existing landfill as shown in Figure 2 of the EP prior to the commencement of construction. It is reminded that the noise bund shall be properly maintained during the construction, operation and restoration of the Project.
- 14.2.4 All other mitigation measures recommended in the EMIS of the EM&A Manual should be properly implemented and maintained as far as practicable.



Appendix A

Location Plan of Enhanced Scheme

of WENTX Landfill Extension

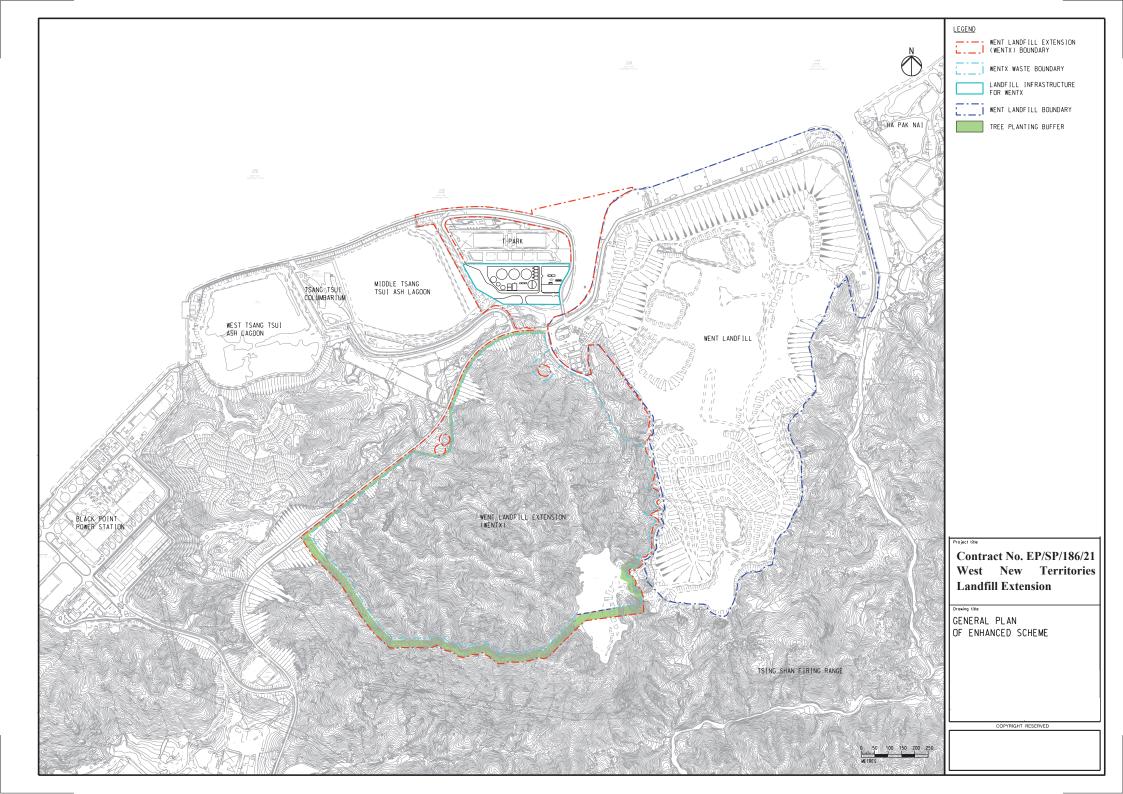




Appendix B

Project Organization and the key personal contact

Flow chart showing Line of Communication and Working Relationship

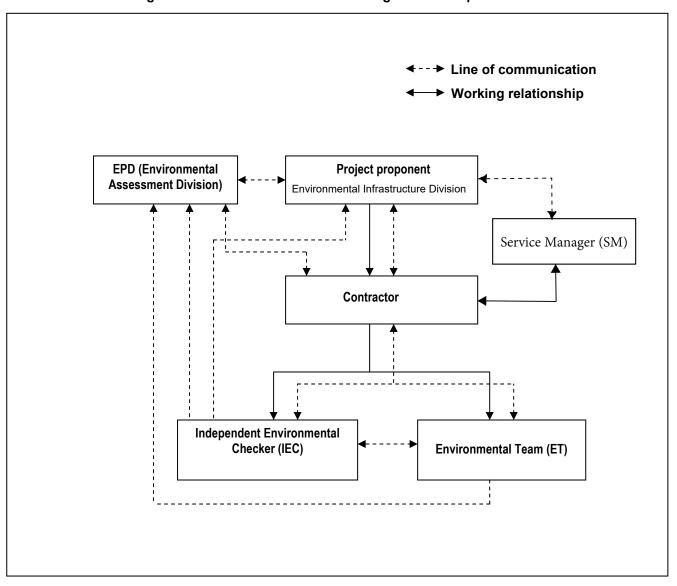



Contact Details of Key Personnel

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
HKRRP	Project Manager	Mr. Victor Wu	2862 5013	
HKRRP	Environmental Manager	Mr. Kenneth Lau	9315 4944	
ANEWR	Independent Environmental Checker	Mr. James Choi	2618 2831	3007 8648
AUES	Environmental Team Leader	Mr. Tam Tak Wing	2959 6059	2959 6079

<u>Legend:</u>

ANEWR (IEC) – ANewR Consulting Limited

AUES (ET) – Action-United Environmental Services & Consulting

HKRRP - (the Contractor) - Hong Kong Resources Recovery Park



Appendix C

3-month Rolling Construction Programme


Construction Programme (Jul 2025 to Oct 2025) West New Territories Landfill Extension (WENTX)


Construction Activities		2025						
Construction Activities	Jul	Aug	Sep	Oct				
Eastern Platform - Site Formation								
- Soft Excavation								
- Rock Excavation								
- Blasting								
Landfill Waste Filling Area (Phase I) - Site Formation								
- Soft Excavation								
- Rock Excavation								
- Blasting								
Crusher and Conveyor Belt System	<u> </u>							
- Rock Crushing								
Fresh Water Pump House and Fresh Water Pipe Connection								
- Pipe Laying Works								
- Consturction of Pump House								
River Surge Box Culvert Construction								
- Box Culvert Construction								
Marine Works								
- DCM & DJM Work								
- Maintenance Dredging Work								
Leachate Treatment Works & Landfill Gas Treatment Plant								
- Box Culvert								
- Footing Constrcution								
- RC Structure								
Construction of Site Office and new haul road								




Appendix D

Monitoring Locations

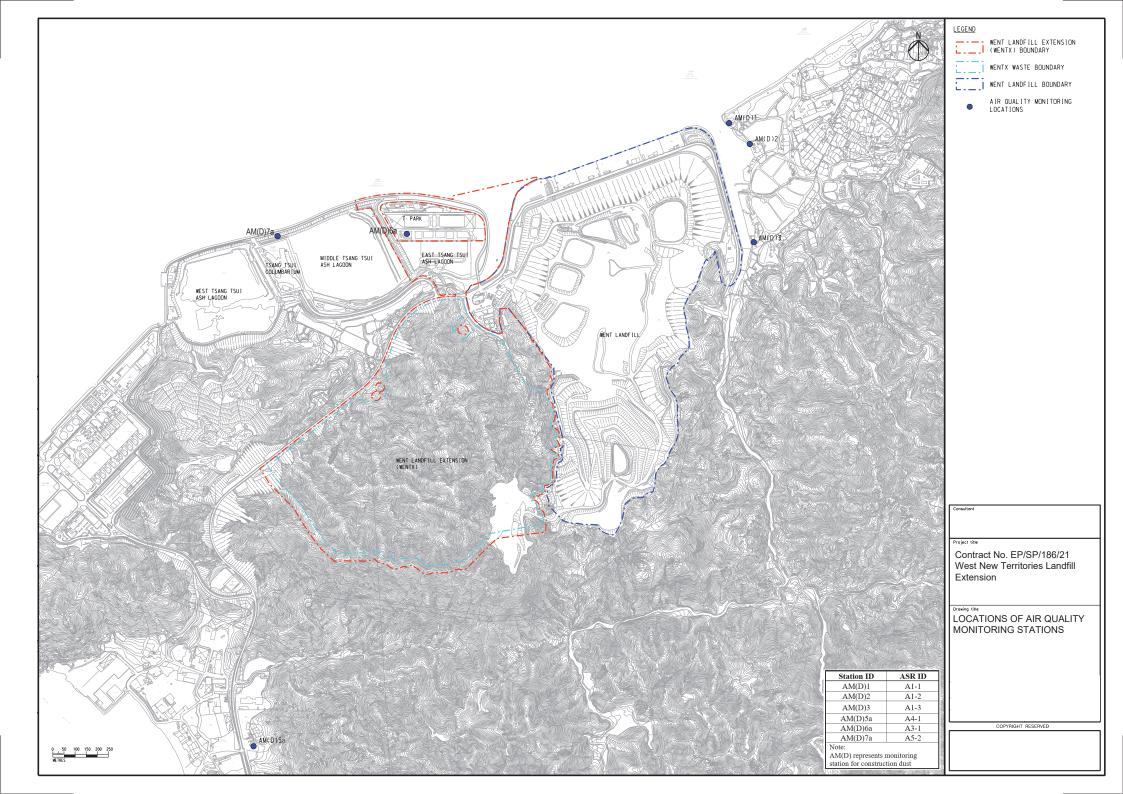

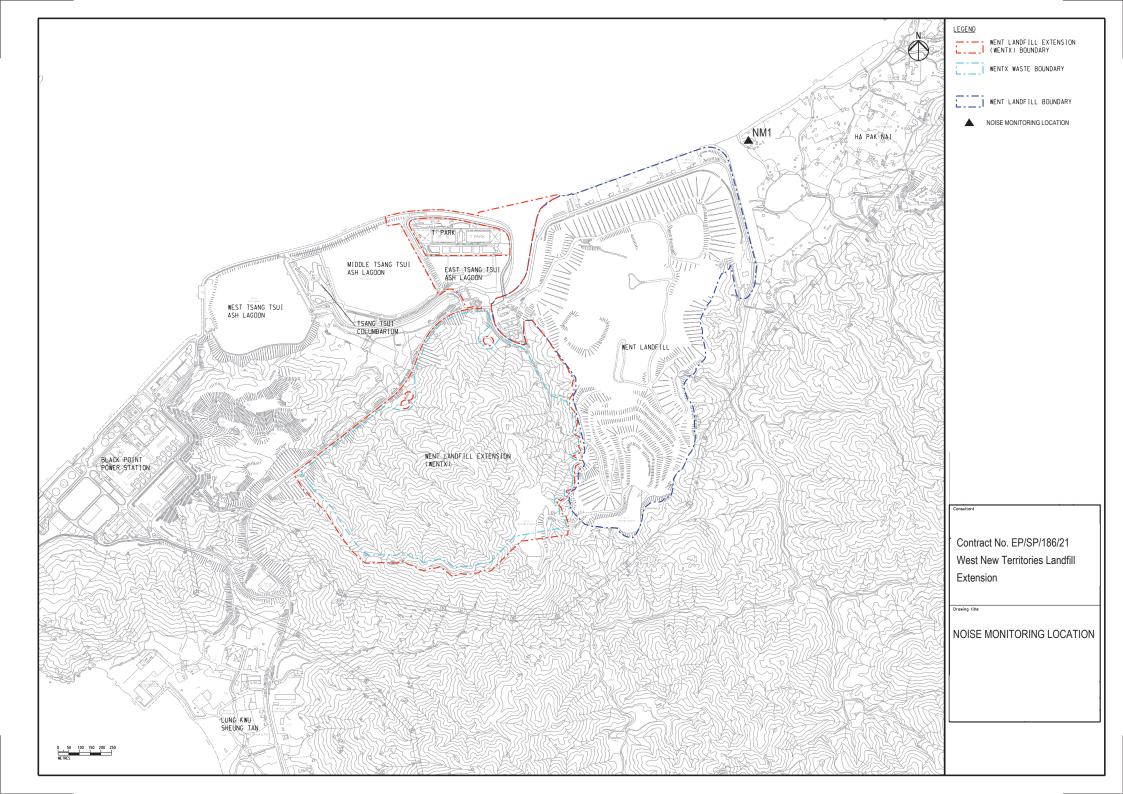

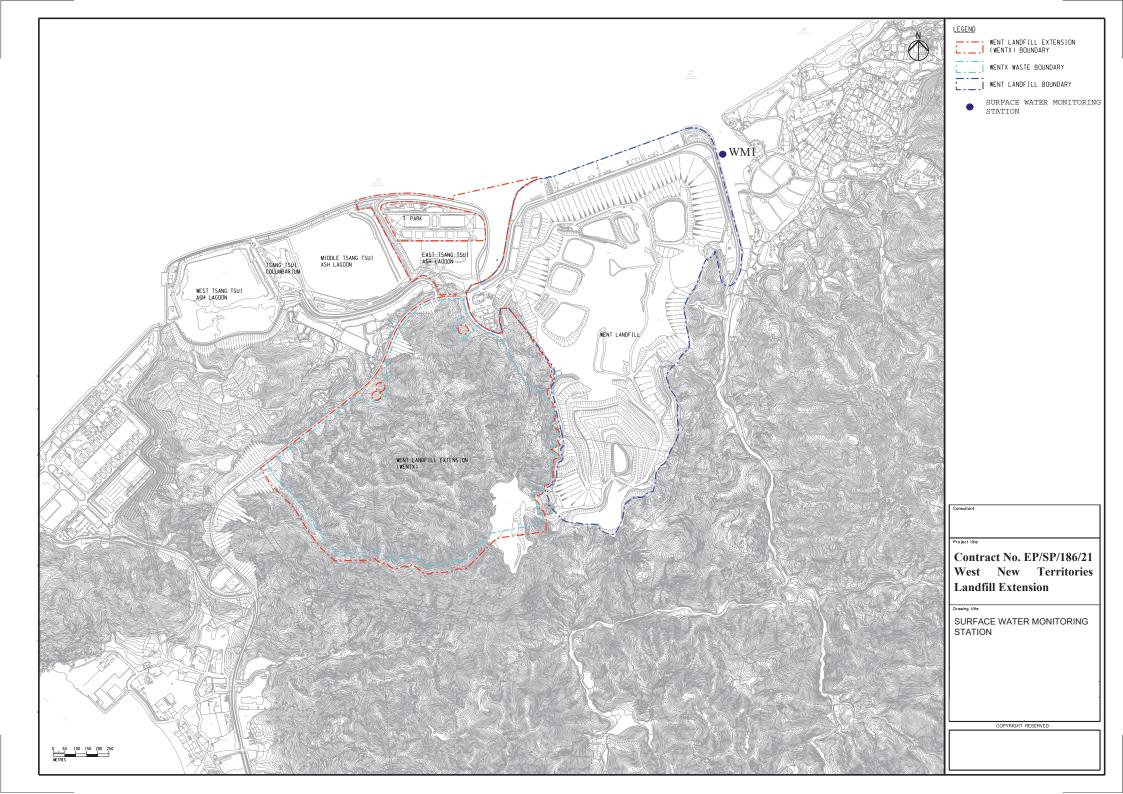



Appendix E

Calibration Certificates



Appendix E1

Calibration Certificates for

Air Quality Monitoring Equipment

Location: Ha Pak Nai

Location ID: AM(D)1

Date of Calibration: 16 Jun 25

Next Calibration Date: 16 Aug 25

Model:TISCH High Volume Air Sampler TE-5170 Technician: Gary Ng

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.7 29.4 Corrected Pressure (mm Hg)
Temperature (K)

302

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 4064

Qstd Slope -> Qstd Intercept ->

2.09671 -0.01852

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.10	6.10	12.2	1.658	55	54.05	Slope = 28.8980
13	4.80	4.80	9.6	1.472	49	48.15	Intercept = 5.8498
10	3.60	3.60	7.2	1.276	43	42.26	Corr. coeff. = 0.9989
7	2.20	2.20	4.4	0.999	36	35.38	
5	1.50	1.50	3.0	0.827	30	29.48	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

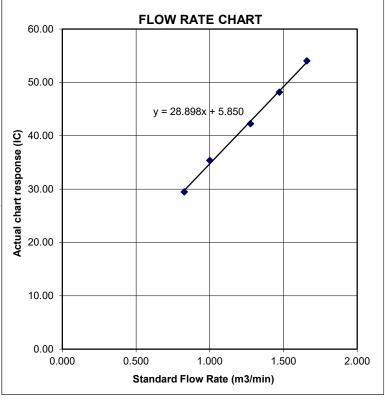

Location: Ha Pak Nai

Date of Calibration: 16 Jun 25

Location ID: AM(D)2

Next Calibration Date: 16 Aug 25

Model:TISCH High Volume Air Sampler TE-5170 Technician: Gary Ng

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.7 29.4

Corrected Pressure (mm Hg)
Temperature (K)

755.775 302

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025A
Serial # -> 4064

Qstd Slope -> Qstd Intercept -> 2.09671 -0.01852

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.20	6.20	12.4	1.671	55	54.05	Slope = 32.4389
13	5.00	5.00	10.0	1.502	50	49.14	Intercept = -0.3945
10	3.80	3.80	7.6	1.310	42	41.27	Corr. coeff. = 0.9946
7	2.60	2.60	5.2	1.085	34	33.41	
5	1.60	1.60	3.2	0.853	29	28.50	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

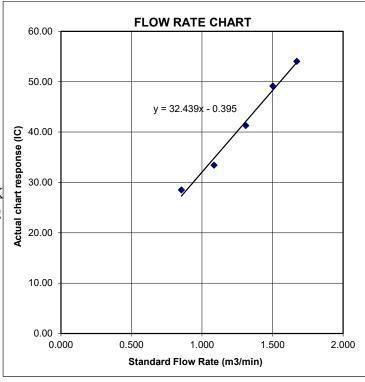

Location: Ha Pak Nai

Date of Calibration: 16 Jun 25

Location ID: AM(D)3

Next Calibration Date: 16 Aug 25

Model:TISCH High Volume Air Sampler TE-5170 Technician: Gary Ng

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.7 29.4

Corrected Pressure (mm Hg)
Temperature (K)

755.775 302

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025 A
Serial # -> 4064

Qstd Slope -> Qstd Intercept ->

2.09671 -0.01852

CALIBRATION

Pla	te	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No	0.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
1	8	6.50	6.50	13.0	1.711	55	54.05	Slope = 27.3819
1.	3	5.20	5.20	10.4	1.531	48	47.17	Intercept = 6.3560
10	0	3.70	3.70	7.4	1.293	43	42.26	Corr. coeff. = 0.9961
7	7	2.60	2.60	5.2	1.085	36	35.38	
5	Ď	1.50	1.50	3.0	0.827	30	29.48	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

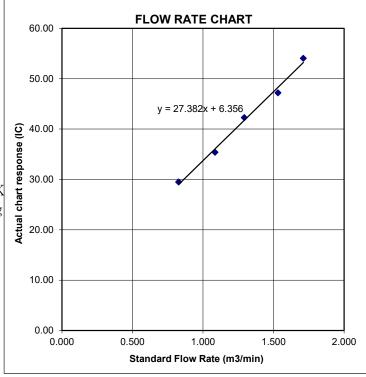

Location: Lung Kwu Sheung Tan

Date of Calibration: 16 Jun 25

Location ID: AM(D)5a

Next Calibration Date: 16 Aug 25

Model:TISCH High Volume Air Sampler TE-5170 Technician: Gary Ng

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.7 29.4

Corrected Pressure (mm Hg)
Temperature (K)

755.775 302

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025 A
Serial # -> 4064

Qstd Slope -> Qstd Intercept ->

2.09671 -0.01852

CALIBRATION

Pla	te	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
N	0.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
1	8	6.00	6.00	12.0	1.644	54	53.07	Slope = 29.9366
1.	3	4.50	4.50	9.0	1.425	45	44.22	Intercept = 2.8967
1	0	3.50	3.50	7.0	1.258	41	40.29	Corr. coeff. = 0.9954
7	7	2.50	2.50	5.0	1.065	36	35.38	
5	Ď	1.60	1.60	3.2	0.853	29	28.50	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

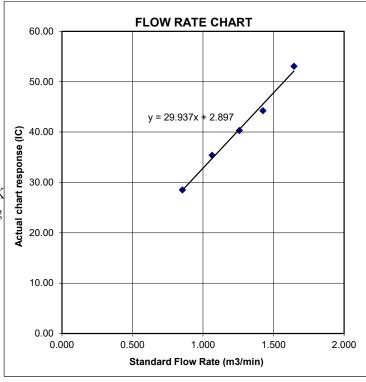

Location: Roof Top of T-Park Workshop

Location ID: AM(D)6a

Date of Calibration: 16 Jun 25

Next Calibration Date: 16 Aug 25

Model:TISCH High Volume Air Sampler TE-5170 Technician: Gary Ng

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.7 29.4

Corrected Pressure (mm Hg)
Temperature (K)

755.775 302

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025 A
Serial # -> 4064

Qstd Slope -> Qstd Intercept ->

2.09671 -0.01852

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.20	6.20	12.4	1.671	51	50.12	Slope = 29.0491
13	5.00	5.00	10.0	1.502	45	44.22	Intercept = 0.5778
10	4.00	4.00	8.0	1.344	39	38.33	Corr. coeff. = 0.9947
7	2.60	2.60	5.2	1.085	32	31.45	
5	1.50	1.50	3.0	0.827	26	25.55	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

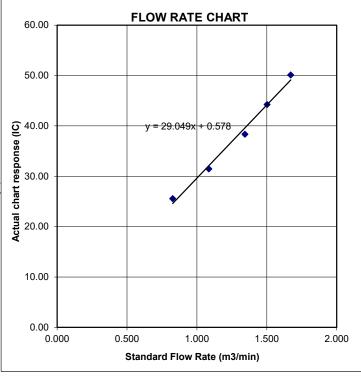

Location: Site Boundary of Middle Ash Lagoon

Location ID: AM(D)7a

Date of Calibration: 16 Jun 25 Next Calibration Date: 16 Aug 25

Model:TISCH High Volume Air Sampler TE-5170

Technician: Gary Ng

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C) 1007.7 29.4

Corrected Pressure (mm Hg)
Temperature (K)

755.775 302

CALIBRATION ORIFICE

Make-> TISCH
Model-> 5025 A
Serial # -> 4064

Qstd Slope -> Qstd Intercept ->

2.09671 -0.01852

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.40	6.40	12.8	1.698	53	52.08	Slope = 25.9761
13	5.10	5.10	10.2	1.517	48	47.17	Intercept = 7.6246
10	4.00	4.00	8.0	1.344	42	41.27	Corr. coeff. = 0.9952
7	2.50	2.50	5.0	1.065	37	36.36	
5	1.60	1.60	3.2	0.853	30	29.48	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

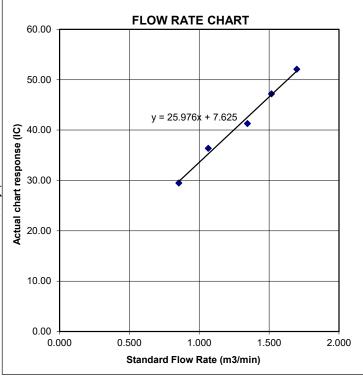



RECALIBRATION DUE DATE:

December 16, 2025

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 16, 2024

Rootsmeter S/N: 438320

Ta: 293 **Pa:** 749.0

°K mm Hg

Operator: Jim Tisch
Calibration Model #:

TE-5025A

Calibrator S/N: 4064

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4600	3.2	2.00
2	3	4	1	1.0300	6.4	4.00
3	5	6	1	0.9220	8.0	5.00
4	7	8	1	0.8770	8.8	5.50
5	9	10	1	0.7250	12.8	8.00

	Data Tabulation							
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)			
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)			
0.9981	0.6836	1.4159	0.9957	0.6820	0.8845			
0.9938	0.9649	2.0024	0.9915	0.9626	1.2509			
0.9917	1.0756	2.2388	0.9893	1.0730	1.3985			
0.9906	1.1296	2.3480	0.9883	1.1269	1.4668			
0.9853	1.3590	2.8318	0.9829	1.3557	1.7690			
	m=	2.09671		m=	1.31292			
QSTD	b=	-0.01852	QA	b=	-0.01157			
	r=	0.99999		r=	0.99999			

Calculations							
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va= ΔVol((Pa-ΔP)/Pa)						
Qstd= Vstd/ΔTime	Qa= Va/ΔTime						
For subsequent flow rate calculations:							
Qstd= $1/m \left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b$	$Qa = 1/m \left(\left(\sqrt{\Delta H \left(Ta/Pa \right)} \right) - b \right)$						

	Standard Conditions					
Tstd:	298.15 °K					
Pstd:	760 mm Hg					
	Key					
ΔH: calibrator manometer reading (in H2O)						
ΔP: rootsmeter manometer reading (mm Hg)						
Ta: actual absolute temperature (°K)						
Pa: actual barometric pressure (mm Hg)						
b: intercept						
m: slope						

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



CERTIFICATE OF CALIBRATION AND TESTING

TSI Singapore Pte Ltd 150, Kampong Ampat #05-05, KA Centre Singapore 368324 Phone: +65 6595 6391

Environment Conditions		
Temperature	24.0	°C
Relative Humidity	49	%RH
Barometric Pressure	1005.1	hPa

Model	AM520
Serial Number	5202337003

☐ As Left ☐ In Tolerance ☐ Out of Tolerance



Concentration Linearity Plot 100 100 0 = In Tolerance • = Out of Tolerance Aerosol Concentration (mg/m^3) System ID: DTII04-01

CONCENTRATION Unit: mg/m									
#	STANDARD	MEASURED	ALLOWABLE RANGE	# "	STANDARD	MEASURED	ALLOWABLE RANGE		
1	0.7	0.7	0.5~0.9	4	13.7	13.7	12.3~15.0		
2	0.2	0.2	0.1~0.2	5	45.3	46.5	40.8~49.8		
3	0.1	0.1	0.1~0.1	7 25					

TSI Incorporated does hereby certify that all materials, components, and workmanship used in the manufacture of this equipment are in strict accordance with the applicable specifications agreed upon by TSI and the customer and with all published specifications. All performance and acceptance tests required under this contract were successfully conducted according to required specifications. There is no NIST standard for optical mass measurements. Calibration of this instrument performed by TSI has been done using emery oil and has been nominally adjusted to respirable mass per standard ISO 12103-1, A1 test dust (Arizona dust). Our calibration ratio is greater than 4:1.

Measurement Variable	System ID	Last Cal.	Cal. Due	Measurement Variable	System ID	Last Cal.	Cal. Due
DC Voltage			31-01-25		E020123	17-01-24	31-01-25
Microbalance	E020125	19-01-24	31-01-25	Photometer	E020114	20-03-24	30-09-24
Eloumater	E020110	13.05.24	31.05.25				



15 August, 2024

Calibrated

Date

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



SUB-CONTRACTING REPORT

CONTACT : MR BEN TAM

WORK ORDER : HK2509

CLIENT

ADDRESS

: ACTION-UNITED ENVIRONMENTAL

HK2509010

SERVICES & CONSULTING

SERVICES & CONST

: RM A 20/F., GOLD KING IND BLDG, NO. 35-41

SUB-BATCH : 1

DATE RECEIVED : 4-MAR-2025

TAI LIN PAI ROAD, KWAI CHUNG, N.T.

DATE OF ISSUE : 11-MAR-2025

PROJECT : ---

NO. OF SAMPLES : 1
CLIENT ORDER :--

General Comments

Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.

- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the
 item(s) tested.
- Sample(s) was/ were picked up from client by ALS staff. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to Action-United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

: HK2509010 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2509010-001	S/N: 366410	AIR	04-Mar-2025	S/N: 366410

----- END OF REPORT -----

 $\mathsf{Page}: 2 \ \mathsf{of} \ 2$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 366410

Equipment Ref: EQ110

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 18

Last Calibration Date: 12 November 2024

Equipment Verification Results:

Verification Date: 17 January 2025

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
17-Jan-25	2hr00min	10:00 ~ 12:00	15.5	1022.9	41.4	2488	20.7
17-Jan-25	2hr00min	12:10 ~ 14:10	15.5	1022.9	34.6	2124	17.7
17-Jan-25	2hr00min	14:15 ~ 16:15	15.5	1022.9	51.9	2796	23.3

^(*) Suspended particle was added into calibration room of HVS019 for high concentration test.

Sensitivity Adjustment Scale Setting (Before Calibration) 674

Sensitivity Adjustment Scale Setting (After Calibration) 674 (CPM)

Linear Regression of Y or X

Slope (K-factor): <u>2.1181 (µg/m³)/CPM</u>


Correlation Coefficient (R) 0.9936

Date of Issue 7 February 2025

Remarks:

- 1. **Strong** Correlation (R>0.8)
- Factor 2.1181 (μg/m³)/CPM should be apply for TSP monitoring

^{*}If R<0.5, repair or re-verification is required for the equipment

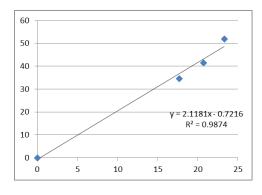

(CPM)

Operator :	Jeff lp	Signature : _		~	Date :	7 February 2025
			,			

QC Reviewer : <u>Ben Tam</u> Signature : <u>Date : 7 February 2025</u>

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 12-Nov-24 Location ID: Calibration Room - TISCH Higher Volume Sampler (Model Next Calibration Date: 12-Feb-25

TE-5170) S/N:1260

CONDITIONS

Sea Level Pressure (hPa) 1012.3 Corrected Pressure (mm Hg) 759
Temperature (°C) 25.9 Temperature (K)

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13163
Model->	5025A	Qstd Intercept ->	-0.03523
Calibration Date->	15-Dec-23	Expiry Date->	15-Dec-24

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	Ι	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.9	6.9	13.8	1.756	44	43.91	Slope = 39.3880
13	5.5	5.5	11.0	1.569	39	38.92	Intercept = -23.8290
10	4.3	4.3	8.6	1.389	32	31.94	Corr. coeff. = 0.9969
8	2.7	2.7	5.4	1.104	20	19.96	
5	1.7	1.7	3.4	0.880	10	9.98	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart respones

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

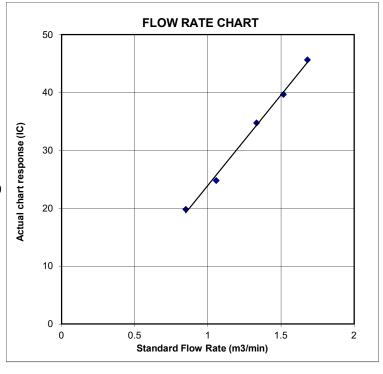



RECALIBRATION DUE DATE:

December 15, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 15, 2023

Rootsmeter S/N: 438320

Ta: 295

Pa: 748.5

°K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1941

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4590	3.2	2.00
2	3	4	1	1.0360	6.4	4.00
3	5	6	1	0.9260	8.0	5.00
4	7	8	1	0.8840	8.9	5.50
5	9	10	1	0.7290	12.9	8.00

	Data Tabulation								
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)				
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)				
0.9907	0.6790	1.4106	0.9957	0.6825	0.8878				
0.9864	0.9522	1.9949	0.9914	0.9570	1.2556				
0.9843	1.0630	2.2304	0.9893	1.0684	1.4037				
0.9831	1.1121	2.3393	0.9881	1.1178	1.4723				
0.9778	1.3413	2.8213	0.9828	1.3481	1.7756				
	m=	2.13163		m=	1.33479				
QSTD	b=	-0.03523	QA	b=	-0.02217				
	r=	0.99999		r=	0.99999				

Calculations								
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)					
Qstd=	Vstd/∆Time	Qa=	= Va/ΔTime					
	For subsequent flow rate calculations:							
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$					

Standard Conditions						
Tstd:	298.15 °K					
Pstd:	760 mm Hg					
	Key					
	or manometer reading (in H2O)					
	ter manometer reading (mm Hg)					
	solute temperature (°K)					
Pa: actual barometric pressure (mm Hg)						
b: intercept						
m: slope						

RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



SUB-CONTRACTING REPORT

HK2512470 WORK ORDER CONTACT : MR BEN TAM

CLIENT : ACTION-UNITED ENVIRONMENTAL

SERVICES & CONSULTING

: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 **ADDRESS** SUB-BATCH

> DATE RECEIVED : 21-MAR-2025 TAI LIN PAI ROAD, KWAI CHUNG, N.T. DATE OF ISSUE : 1-APR-2025

PROJECT NO. OF SAMPLES : 1

CLIENT ORDER

General Comments

Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.

- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories Position

Richard Fung

Managing Director

: HK2512470 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2512470-001	S/N: 456662	AIR	21-Mar-2025	S/N: 456662

----- END OF REPORT -----

 $\mathsf{Page}: 2 \ \mathsf{of} \ 2$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-3B

Serial No. 456662

Equipment Ref: EQ118

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 12 February 2025

Equipment Verification Results:

Verification Date: 11 March 2025

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
11-Mar-25	2hr00mins	11:00 ~ 13:00	22.0	1016.6	59.7	3624	30.2
11-Mar-25	2hr09mins	13:07 ~ 13:16	22.0	1016.6	59.0	3685	28.6
11-Mar-25	2hr00mins	15:17 ~ 17:17	22.0	1018.8	67.7	3895	32.5

Sensitivity Adjustment Scale Setting (Before Calibration)

591 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration)


589 (CPM)

Linear Regression of Y or X

Slope (K-factor): $2.0469 (\mu g/m^3)/CPM$

Correlation Coefficient (R) 0.9989

Date of Issue 18 March 2025

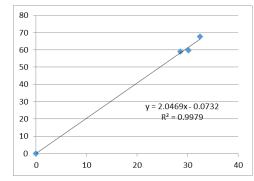

Remarks:

1. **Strong** Correlation (R>0.8)

2. Factor 2.0469 (µg/m³)/CPM should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : _______ Date : ______ Date : ______ Date : ______

QC Reviewer : Ben Tam Signature : Date : 18 March 2025

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 12-Feb-25
Location ID: Calibration Room - TISCH Higher Volume Sampler (Model Next Calibration Date: 12-May-25

TE-5170) S/N:1260

CONDITIONS

Sea Level Pressure (hPa)1017.2Corrected Pressure (mm Hg)762.9Temperature (°C)18.8Temperature (K)292

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.09671
Model->	5025A	Qstd Intercept ->	-0.01852
Calibration Date->	16-Dec-24	Expiry Date->	16-Dec-25

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	5.6	5.6	11.2	1.625	55	55.69	Slope = 35.3445
13	4.5	4.5	9.0	1.458	48	48.60	Intercept = -2.1779
10	3.4	3.4	6.8	1.268	42	42.52	Corr. coeff. = 0.9989
8	2.3	2.3	4.6	1.045	35	35.44	
5	1.2	1.2	2.4	0.757	24	24.30	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:


1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)

m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

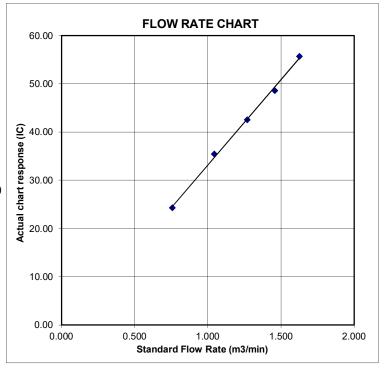



RECALIBRATION DUE DATE:

December 16, 2025

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 16, 2024

Rootsmeter S/N: 438320

Ta: 293 **Pa:** 749.0

°K mm Hg

Operator: Jim Tisch
Calibration Model #:

TE-5025A

Calibrator S/N: 4064

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4600	3.2	2.00
2	3	4	1	1.0300	6.4	4.00
3	5	6	1	0.9220	8.0	5.00
4	7	8	1	0.8770	8.8	5.50
5	9	10	1	0.7250	12.8	8.00

	Data Tabulation							
Vstd	td Qstd $\sqrt{\Delta H(\frac{Pa}{Pstd})(\frac{Tstd}{Ta})}$			Qa	√∆H(Ta/Pa)			
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)			
0.9981	0.6836	1.4159	0.9957	0.6820	0.8845			
0.9938	0.9649	2.0024	0.9915	0.9626	1.2509			
0.9917	1.0756	2.2388	0.9893	1.0730	1.3985			
0.9906	1.1296	2.3480	0.9883	1.1269	1.4668			
0.9853	1.3590	2.8318	0.9829	1.3557	1.7690			
	m=	2.09671		m=	1.31292			
QSTD	b=	-0.01852	QA	b=	-0.01157			
	r=	0.99999		r=	0.99999			

Calculations							
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va= ΔVol((Pa-ΔP)/Pa)						
Qstd= Vstd/ΔTime	Qa= Va/ΔTime						
For subsequent flow rate calculations:							
Qstd= $1/m \left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b$	$Qa = 1/m \left(\left(\sqrt{\Delta H \left(Ta/Pa \right)} \right) - b \right)$						

Standard Conditions		
Tstd:	298.15 °K	
Pstd:	760 mm Hg	
Key		
ΔH: calibrator manometer reading (in H2O)		
ΔP: rootsmeter manometer reading (mm Hg)		
Ta: actual absolute temperature (°K)		
Pa: actual barometric pressure (mm Hg)		
b: intercept		
m: slope		

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



SUB-CONTRACTING REPORT

CONTACT : MR BEN TAM WORK ORDER : HK2437857

CLIENT : ACTION-UNITED ENVIRONMENTAL

SERVICES & CONSULTING

ADDRESS : RM A 20/F., GOLD KING IND BLDG, NO. 35-41 SUB-BATCH :

TAI LIN PAI ROAD, KWAI CHUNG, N.T.

DATE RECEIVED : 16-SEP-2024

DATE OF ISSUE : 24-SEP-2024

PROJECT : ---- NO. OF SAMPLES : 1

CLIENT ORDER ÷

General Comments

Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.

- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the
 item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

: HK2437857 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2437857-001	S/N: 467389 (EQ125)	AIR	16-Sep-2024	S/N: 467389 (EQ125)

----- END OF REPORT -----

 $\mathsf{Page}: 2 \ \mathsf{of} \ 2$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-5R

Serial No. 467389

Equipment Ref: EQ125

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 15 August 2024

Equipment Verification Results:

Verification Date: 3 September 2024

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
3-Sep-24	2hr00mins	09:26 ~ 11:26	30.2	1006.1	24.3	2216	18.5
3-Sep-24	2hr00mins	11:37 ~ 13:37	30.2	1006.1	42.3	3932	32.8
3-Sep-24	2hr00mins	12:49 ~ 14:49	30.2	1006.1	45.5	4413	36.8

Sensitivity Adjustment Scale Setting (Before Calibration)

704 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration)


705 (CPM)

Linear Regression of Y or X

Slope (K-factor): <u>1.2542 (μg/m³)/CPM</u>

Correlation Coefficient (R) 0.9991

Date of Issue 10 September 2024

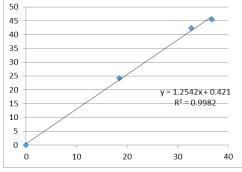

Remarks:

1. **Strong** Correlation (R>0.8)

2. Factor 1.2542 (µg/m³)/CPM should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : _____ Martin Li Signature : _____ Date : ____ Date : ____ 10 September 2024

QC Reviewer : Ben Tam Signature : Date : 10 September 2024

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 15-Aug-24
Location ID: Calibration Room - TISCH Higher Volume Sampler (Model Next Calibration Date: 15-Nov-24

TE-5170) S/N:1260

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

1005	.2
27.	.7

Corrected Pressure (mm Hg)
Temperature (K)

753.9 301

CALIBRATION ORIFICE

Make->	TISCH
Model->	5025A
Calibration Date->	

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.13163 -0.03523 15-Dec-24

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.4	6.4	12.8	1.681	46	45.61	Slope = 31.2876
13	5.2	5.2	10.4	1.517	40	39.66	Intercept = -7.3464
10	4	4	8.0	1.332	35	34.70	Corr. coeff. = 0.9981
8	2.5	2.5	5.0	1.057	25	24.79	
5	1.6	1.6	3.2	0.849	20	19.83	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

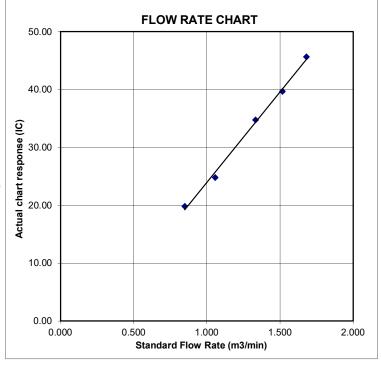



RECALIBRATION DUE DATE:

December 15, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 15, 2023

Rootsmeter S/N: 438320

Ta: 295

Pa: 748.5

°K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1941

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4590	3.2	2.00
2	3	4	1	1.0360	6.4	4.00
3	5	6	1	0.9260	8.0	5.00
4	7	8	1	0.8840	8.9	5.50
5	9	10	1	0.7290	12.9	8.00

Data Tabulation						
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)	
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)	
0.9907	0.6790	1.4106	0.9957	0.6825	0.8878	
0.9864	0.9522	1.9949	0.9914	0.9570	1.2556	
0.9843	1.0630	2.2304	0.9893	1.0684	1.4037	
0.9831	1.1121	2.3393	0.9881	1.1178	1.4723	
0.9778	1.3413	2.8213	0.9828	1.3481	1.7756	
	m=	2.13163		m=	1.33479	
QSTD	b=	-0.03523	QA	b=	-0.02217	
	r=	0.99999		r=	0.99999	

Calculations							
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)				
Qstd=	Qstd= Vstd/ΔTime		Va/ΔTime				
	For subsequent flow rate calculations:						
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$				

Standard Conditions					
Tstd:	298.15 °K				
Pstd:	760 mm Hg				
	Key				
ΔH: calibrator manometer reading (in H2O)					
ΔP: rootsmeter manometer reading (mm Hg)					
Ta: actual absolute temperature (°K)					
Pa: actual barometric pressure (mm Hg)					
b: intercept					
m: slope					

RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



HK2437858

SUB-CONTRACTING REPORT

CONTACT : MR BEN TAM WORK ORDER

CLIENT : ACTION-UNITED ENVIRONMENTAL

SERVICES & CONSULTING

ADDRESS : RM A 20/F., GOLD KING IND BLDG, NO. 35-41 SUB-BATCH

TAI LIN PAI ROAD, KWAI CHUNG, N.T.

DATE RECEIVED : 16-SEP-2024

DATE OF ISSUE : 24-SEP-2024

PROJECT : ---- NO. OF SAMPLES : 1

CLIENT ORDER :--

General Comments

• Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.

Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the
item(s) tested.

• Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.

Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

: HK2437858 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2437858-001	S/N: 467390 (EQ126)	AIR	16-Sep-2024	S/N: 467390 (EQ126)

----- END OF REPORT -----

 $\mathsf{Page}: 2 \ \mathsf{of} \ 2$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-5R

Serial No. 467390

Equipment Ref: EQ126

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 15 August 2024

Equipment Verification Results:

Verification Date: 3 September 2024

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
3-Sep-24	2hr00mins	09:26 ~ 11:26	30.2	1006.1	24.3	2225	18.5
3-Sep-24	2hr00mins	11:37 ~ 13:37	30.2	1006.1	42.3	4033	33.6
3-Sep-24	2hr00mins	12:49 ~ 14:49	30.2	1006.1	45.5	4455	37.1

Sensitivity Adjustment Scale Setting (Before Calibration)

613 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration)


612 (CPM)

Linear Regression of Y or X

Slope (K-factor): <u>1.2335 (μg/m³)/CPM</u>

Correlation Coefficient (R) 0.9993

Date of Issue 10 September 2024

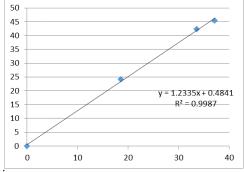

Remarks:

1. **Strong** Correlation (R>0.8)

2. Factor 1.2335 (µg/m³)/CPM should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : Martin Li Signature : Date : 10 September 2024

QC Reviewer : Ben Tam Signature : Date : 10 September 2024

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 15-Aug-24
Location ID: Calibration Room - TISCH Higher Volume Sampler (Model Next Calibration Date: 15-Nov-24

TE-5170) S/N:1260

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

1005	.2
27.	.7

Corrected Pressure (mm Hg)
Temperature (K)

753.9 301

CALIBRATION ORIFICE

Make->	TISCH
Model->	5025A
Calibration Date->	

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.13163 -0.03523 15-Dec-24

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.4	6.4	12.8	1.681	46	45.61	Slope = 31.2876
13	5.2	5.2	10.4	1.517	40	39.66	Intercept = -7.3464
10	4	4	8.0	1.332	35	34.70	Corr. coeff. = 0.9981
8	2.5	2.5	5.0	1.057	25	24.79	
5	1.6	1.6	3.2	0.849	20	19.83	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

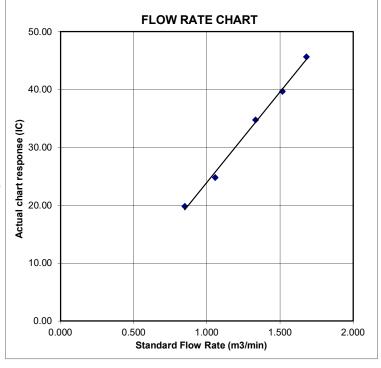



RECALIBRATION DUE DATE:

December 15, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 15, 2023

Rootsmeter S/N: 438320

Ta: 295

Pa: 748.5

°K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1941

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4590	3.2	2.00
2	3	4	1	1.0360	6.4	4.00
3	5	6	1	0.9260	8.0	5.00
4	7	8	1	0.8840	8.9	5.50
5	9	10	1	0.7290	12.9	8.00

	Data Tabulation									
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)					
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)					
0.9907	0.6790	1.4106	0.9957	0.6825	0.8878					
0.9864	0.9522	1.9949	0.9914	0.9570	1.2556					
0.9843	1.0630	2.2304	0.9893	1.0684	1.4037					
0.9831	1.1121	2.3393	0.9881	1.1178	1.4723					
0.9778	1.3413	2.8213	0.9828	1.3481	1.7756					
	m=	2.13163		m=	1.33479					
QSTD	b=	-0.03523	QA	b=	-0.02217					
	r=	0.99999		r=	0.99999					

Calculations								
$Vstd = \Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$ $Va = \Delta Vol((Pa-\Delta P)/Pa)$								
Qstd=	Vstd/∆Time	Qa=	Va/ΔTime					
For subsequent flow rate calculations:								
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$					

Standard Conditions							
Tstd:	298.15 °K						
Pstd:	760 mm Hg						
	Key						
	ΔH: calibrator manometer reading (in H2O)						
ΔP: rootsmeter manometer reading (mm Hg)							
	Ta: actual absolute temperature (°K)						
Pa: actual barometric pressure (mm Hg)							
b: intercept							
m: slope							

RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



HK2437859

SUB-CONTRACTING REPORT

CONTACT : MR BEN TAM

CLIENT : ACTION-UNITED ENVIRONMENTAL

SERVICES & CONSULTING

: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 **ADDRESS**

DATE RECEIVED : 16-SEP-2024

TAI LIN PAI ROAD, KWAI CHUNG, N.T. DATE OF ISSUE : 24-SEP-2024

PROJECT NO. OF SAMPLES: 1

CLIENT ORDER

WORK ORDER

SUB-BATCH

General Comments

Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.

Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.

Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

: HK2437859 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2437859-001	S/N: 467391 (EQ127)	AIR	16-Sep-2024	S/N: 467391 (EQ127)

----- END OF REPORT -----

 $\mathsf{Page}: 2 \ \mathsf{of} \ 2$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-5R

Serial No. 467391

Equipment Ref: EQ127

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 15 August 2024

Equipment Verification Results:

Verification Date: 3 September 2024

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
3-Sep-24	2hr00mins	09:26 ~ 11:26	30.2	1006.1	24.3	2221	18.5
3-Sep-24	2hr00mins	11:37 ~ 13:37	30.2	1006.1	42.3	3972	33.1
3-Sep-24	2hr00mins	12:49 ~ 14:49	30.2	1006.1	45.5	4481	37.3

Sensitivity Adjustment Scale Setting (Before Calibration)

665 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration)


665 (CPM)

Linear Regression of Y or X

Slope (K-factor): <u>1.2362 (μg/m³)/CPM</u>

Correlation Coefficient (R) 0.9987

Date of Issue 10 September 2024

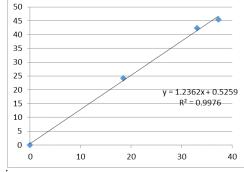

Remarks:

1. **Strong** Correlation (R>0.8)

2. Factor 1.2362 (µg/m³)/CPM should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : Martin Li Signature : Date : 10 September 2024

QC Reviewer : Ben Tam Signature : Date : 10 September 2024

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 15-Aug-24
Location ID: Calibration Room - TISCH Higher Volume Sampler (Model Next Calibration Date: 15-Nov-24

TE-5170) S/N:1260

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

1005	.2
27.	.7

Corrected Pressure (mm Hg)
Temperature (K)

753.9 301

CALIBRATION ORIFICE

Make->	TISCH
Model->	5025A
Calibration Date->	

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.13163 -0.03523 15-Dec-24

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.4	6.4	12.8	1.681	46	45.61	Slope = 31.2876
13	5.2	5.2	10.4	1.517	40	39.66	Intercept = -7.3464
10	4	4	8.0	1.332	35	34.70	Corr. coeff. = 0.9981
8	2.5	2.5	5.0	1.057	25	24.79	
5	1.6	1.6	3.2	0.849	20	19.83	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

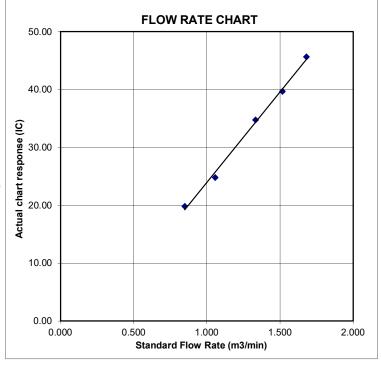



RECALIBRATION DUE DATE:

December 15, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 15, 2023

Rootsmeter S/N: 438320

Ta: 295

Pa: 748.5

°K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1941

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4590	3.2	2.00
2	3	4	1	1.0360	6.4	4.00
3	5	6	1	0.9260	8.0	5.00
4	7	8	1	0.8840	8.9	5.50
5	9	10	1	0.7290	12.9	8.00

	Data Tabulation					
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)	
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)	
0.9907	0.6790	1.4106	0.9957	0.6825	0.8878	
0.9864	0.9522	1.9949	0.9914	0.9570	1.2556	
0.9843	1.0630	2.2304	0.9893	1.0684	1.4037	
0.9831	1.1121	2.3393	0.9881	1.1178	1.4723	
0.9778	1.3413	2.8213	0.9828	1.3481	1.7756	
	m=	2.13163		m=	1.33479	
QSTD	b=	-0.03523	QA	b=	-0.02217	
	r=	0.99999		r=	0.99999	

	Calculations				
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)		
Qstd=	Vstd/∆Time	Qa=	Va/ΔTime		
	For subsequent flow rate calculations:				
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$		

Standard Conditions					
Tstd:	298.15 °K				
Pstd:	760 mm Hg				
	Key				
	ΔH: calibrator manometer reading (in H2O)				
ΔP: rootsmeter manometer reading (mm Hg)					
Ta: actual absolute temperature (°K)					
Pa: actual barometric pressure (mm Hg)					
b: intercept					
m: slope					

RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30

ALS Technichem (HK) Pty Ltd

ALS Laboratory Group

ANALYTICAL CHEMISTRY & TESTING SERVICES



SUB-CONTRACTING REPORT

CONTACT : MR BEN TAM WORK ORDER : HK2437860

CLIENT : ACTION-UNITED ENVIRONMENTAL

SERVICES & CONSULTING

ADDRESS : RM A 20/F., GOLD KING IND BLDG, NO. 35-41 SUB-BATCH : 1

TAI LIN PAI ROAD, KWAI CHUNG, N.T.

DATE RECEIVED : 16-SEP-2024

DATE OF ISSUE : 24-SEP-2024

PROJECT : --- NO. OF SAMPLES : 1

CLIENT ORDER +-

General Comments

• Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.

Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the
item(s) tested.

• Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.

Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories Position

Richard Fung Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

: HK2437860 WORK ORDER

SUB-BATCH

: 1 : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING CLIENT

PROJECT



ALS Lab	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2437860-001	S/N: 467392 (EQ128)	AIR	16-Sep-2024	S/N: 467392 (EQ128)

----- END OF REPORT -----

 $\mathsf{Page}: 2 \ \mathsf{of} \ 2$

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor

Manufacturer: Sibata LD-5R

Serial No. 467392

Equipment Ref: EQ128

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)

Location & Location ID: AUES office (calibration room)

Equipment Ref: HVS 018

Last Calibration Date: 15 August 2024

Equipment Verification Results:

Verification Date: 3 September 2024

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
3-Sep-24	2hr00mins	09:26 ~ 11:26	30.2	1006.1	24.3	2190	18.3
3-Sep-24	2hr00mins	11:37 ~ 13:37	30.2	1006.1	42.3	3887	32.4
3-Sep-24	2hr00mins	12:49 ~ 14:49	30.2	1006.1	45.5	4273	35.6

Sensitivity Adjustment Scale Setting (Before Calibration)

715 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration)


714 (CPM)

Linear Regression of Y or X

Slope (K-factor): 1.2864g/m³)/CPM

Correlation Coefficient (R) 0.9997

Date of Issue 10 September 2024

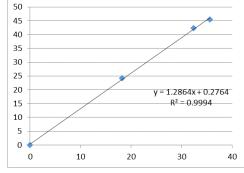

Remarks:

1. **Strong** Correlation (R>0.8)

2. Factor 1.2864g/m³)/CPM should be apply for TSP monitoring

*If R<0.5, repair or re-verification is required for the equipment

Operator : Martin Li Signature : Date : 10 September 2024

QC Reviewer : Ben Tam Signature : Date : 10 September 2024

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location: Gold King Industrial Building, Kwai Chung Date of Calibration: 15-Aug-24
Location ID: Calibration Room - TISCH Higher Volume Sampler (Model Next Calibration Date: 15-Nov-24

TE-5170) S/N:1260

CONDITIONS

Sea Level Pressure (hPa) Temperature (°C)

1005	.2
27.	.7

Corrected Pressure (mm Hg)
Temperature (K)

753.9 301

CALIBRATION ORIFICE

Make->	TISCH
Model->	5025A
Calibration Date->	

Qstd Slope -> Qstd Intercept -> Expiry Date-> 2.13163 -0.03523 15-Dec-24

CALIBRATION

Plate	H20 (L)	H2O (R)	H20	Qstd	I	IC	LINEAR
No.	(in)	(in)	(in)	(m3/min)	(chart)	corrected	REGRESSION
18	6.4	6.4	12.8	1.681	46	45.61	Slope = 31.2876
13	5.2	5.2	10.4	1.517	40	39.66	Intercept = -7.3464
10	4	4	8.0	1.332	35	34.70	Corr. coeff. = 0.9981
8	2.5	2.5	5.0	1.057	25	24.79	
5	1.6	1.6	3.2	0.849	20	19.83	

Calculations:

Qstd = 1/m[Sqrt(H20(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

1/m((I)[Sqrt(298/Tav)(Pav/760)]-b)


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

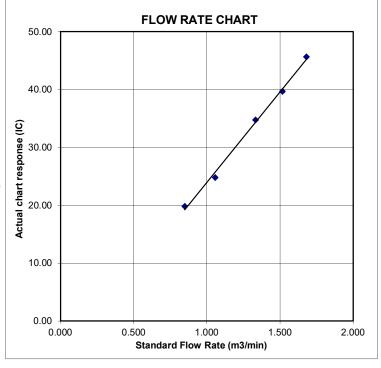



RECALIBRATION DUE DATE:

December 15, 2024

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 15, 2023

Rootsmeter S/N: 438320

Ta: 295

Pa: 748.5

°K

Operator: Jim Tisch

Calibration Model #: TE-5025A

Calibrator S/N: 1941

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4590	3.2	2.00
2	3	4	1	1.0360	6.4	4.00
3	5	6	1	0.9260	8.0	5.00
4	7	8	1	0.8840	8.9	5.50
5	9	10	1	0.7290	12.9	8.00

	Data Tabulation					
Vstd	Qstd	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)	
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)	
0.9907	0.6790	1.4106	0.9957	0.6825	0.8878	
0.9864	0.9522	1.9949	0.9914	0.9570	1.2556	
0.9843	1.0630	2.2304	0.9893	1.0684	1.4037	
0.9831	1.1121	2.3393	0.9881	1.1178	1.4723	
0.9778	1.3413	2.8213	0.9828	1.3481	1.7756	
	m=	2.13163		m=	1.33479	
QSTD	b=	-0.03523	QA	b=	-0.02217	
	r=	0.99999		r=	0.99999	

	Calculations				
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)		
Qstd=	Vstd/∆Time	Qa=	Va/ΔTime		
	For subsequent flow rate calculations:				
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$		

Standard Conditions					
Tstd:	298.15 °K				
Pstd:	760 mm Hg				
	Key				
	ΔH: calibrator manometer reading (in H2O)				
ΔP: rootsmeter manometer reading (mm Hg)					
Ta: actual absolute temperature (°K)					
Pa: actual barometric pressure (mm Hg)					
b: intercept					
m: slope					

RECALIBRATION

US EPA recommends annual recalibration per 1998
40 Code of Federal Regulations Part 50 to 51,
Appendix B to Part 50, Reference Method for the
Determination of Suspended Particulate Matter in
the Atmosphere, 9.2.17, page 30



Appendix E2

Calibration Certificates for

Noise Monitoring Equipment



Certificate No. 411103

Page 1

Customer: Action-Unitod Environmental Services & consulting

Address : Unit A, 20/F, Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, New Territories, Hong Kong

Order No.: Q44140

Date of receipt

25-Oct-24

Item Tested

Description: Sound Level Meter

Manufacturer: B&K

I.D.

: EQ0215

Model

: 2238

Serial No.

: 2285722

Test Conditions

Date of Test:

8-Nov-24

Supply Voltage

Ambient Temperature:

 $(23 \pm 3)^{\circ}C$

Relative Humidity: $(50 \pm 25) \%$

Test Specifications

Calibration check.

The UUT has an indication that it conforms to IEC 61672 Class 1.

Ref. Document/Procedure: Z01, IEC 61672-1:2002.

Test Results

All results were within the IEC 61672 Class 1 specification or Tolerance.(where applicable)

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No. Description

Cert. No.

Traceable to

S017

Multi-Function Generator

C211339

SCL-HKSAR

S240

Sound Level Calibrator

405380

NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

Calibrated by

Approved by:

Kin Wong

This Certificate is issued by

Tel: 2425 8801 Fax: 2425 8646

Hong Kong Calibration Ltd. Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong

8-Nov-24



Certificate No. 411103

Page 2 of 4 Pages

All tests were performed on the UUT's Reference Level Range: 54.0-134.0 dB, unless specified otherwise.

Results:

Acoustical signal test

1. Indication at the Calibration Check Frequency (1kHz)

UUT	Setting	Applied Value (dB)	UUT Reading (dB)
Weight. Response			After Adjust.*
A	F	94.0	93.8
	S		93.8
C	F		93.8
L			93.8

^{*}Adjustment using the customer's sound calibrator was performed immediately before test.

Tolerance : \pm 1.0 dB Uncertainty : \pm 0.1 dB

Self-generated noise (Microphone Installed, most sensitive range): 23.7 dBA

Electrical signal tests

2. Frequency weightings (A,F)

Freq	uency	Attenuation (dB)	IEC 61672-1 Class 1 Spec.		
31.5	Hz	-39.5	- 39.4 dB, ± 1.5 dB		
63	Hz	-26.2	- 26.2 dB, ± 1.0 dB		
125	Hz	-16.2	- 16.1 dB, ± 1.0 dB		
250	Hz	-8.7	- 8.6 dB, ± 1.0 dB		
500	Hz	-3.3	- 3.2 dB, ± 1.0 dB		
1	kHz	0.0 (Ref)	$0 \text{ dB}, \pm 0.7 \text{ dB}$		
2	kHz	+1.2	+ 1.2 dB, ± 1.0 dB		
4	kHz	+0.9	+ 1.0 dB, ± 1.0 dB		
8	kHz	-1.3	- 1.1 dB, + 1.5 dB ~ -2.5 dB		
16	kHz	-6.8	- 6.6 dB , $+ 2.5 \text{ dB} \sim - 16.0 \text{ dB}$		

Uncertainty: $\pm 0.1 \text{ dB}$

Certificate No. 411103

Page 3 of 4 Pages

3. Frequency & Time weightings

3.1 Frequency Weighting (1kHz)

UUT Setting				
Time Weight.	Freq. Weight.	Anticipated Value	UUT	IEC 61672-1
		(dB)	Reading (dB)	Class 1 Spec.
F	A	94.0	94.0 (Ref.)	
	С		94.0	± 0.2 dB
	L		94.0	

Uncertainty: $\pm 0.1 \text{ dB}$

3.2 Time Weighting (1kHz)

UUT Setting				
Time Weight.	Freq. Weight.	Anticipated Value	UUT	IEC 61672-1
		(dB)	Reading (dB)	Class 1 Spec.
F	A	94.0	94.0 (Ref.)	
S			94.0	± 0.1 dB
eq		-	93.9	

Uncertainty: ± 0.1 dB

5. Level Linearity on the Reference Level Range (8 kHz, A, F)

Anticipated Value (dB)	UUT Reading (dB)	IEC 61672-1 Class 1 Spec.
124.0	123.8	± 0.8 dB
114.0	113.9	-
104.0	103.9	-
94.0	94.0 (Ref.)	
84.0	84.0	
74.0	74.0	
64.0	64.1	
54.0	54.2	

Uncertainty: ± 0.1 dB



Certificate No. 411103

Page 4 of 4 Pages

6. Level Linearity including the level range control ($1\ kHz,\,A,\,F$)

UUT Range (dB)	Anticipated Value (dB)	UUT Reading (dB)	IEC 61672-1 Class 1 Spec.
14.0-94.0	94.0	93.8	± 0.8 dB
24.0-104.0		94.0	
34.0-114.0		94.0	
44.0-124.0		94.0	
54.0-134.0		94.0 (Ref.)	
64.0-144.0		94.1	

Uncertainty: ± 0.1 dB

Remarks: 1. UUT: Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure: 1 008 hPa.

4. Microphone model: 4188, S/N: 2812706.

----- END -----

Certificate of Calibration

for

Description:

Sound Level Meter

Manufacturer:

RION

Type No.:

NL-52 (Serial No.: 00921191)

Microphone:

RION UC-59 (Serial No.: 12910)

Preamplifier:

NH-25 (Serial No.: 32609)

Submitted by:

Customer:

Action-United Environmental Services & Consulting

Address:

Unit A, 20/F, Gold King Industrial Building

35-41 Tai Lin Pai Road, Kwai Chung,

New Territories, Hong Kong

Upon receipt for calibration, the instrument was found to be:

☑ Within (31.5Hz – 8kHz)

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 16 December 2024

Date of calibration: 20 December 2024

Date of NEXT calibration: 19 December 2025

Calibrated by:

Calibration Technician

Date of issue: 20 December 2024

Certified by:_

Mr. Ng Yan Wa Laboratory Manager

Certificate No.: APJ24-111-CC001

Page 1 of 4



1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature:

23.3 °C

Air Pressure:

1005 **hPa**

Relative Humidity:

25.1 %

3. Calibration Equipment:

Type

Serial No.

Calibration Report Number

Traceable to

Multifunction Calibrator

B&K 4226

2288467

AV240081

HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Sett	Setting of Unit-under-test (UUT)				ied value	UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. V	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	Veighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB Frequency, Hz		dB	Specification, dB
20.120	JD A	CDI	Fast	94	1000	94.0	Ref
30-130	30-130 dBA SPL	SPL	Slow	94	1000	94.0	±0.3

Certificate No.: APJ24-111-CC001



Page 2 of 4



Frequency Response

Linear Response

Sett	ing of U	nit-under-t	est (UUT)	Appl	Applied value		IEC 61672 Class 1
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	94.0	±2.0
					63	94.2	±1.5
					125	94.1	±1.5
					250	94.1	±1.4
30-130	dB	SPL	Fast	94	500	94.1	±1.4
					1000	94.0	Ref
					2000	93.6	±1.6
					4000	92.8	±1.6
					8000	91.0	+2.1; -3.1

A-weighting

Setti	ing of U	nit-under-t	est (UUT)	Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	54.7	-39.4 ±2.0
					63	68.0	-26.2 ±1.5
					125	78.0	-16.1 ±1.5
					250	85.4	-8.6 ±1.4
30-130	dBA	SPL	Fast	94	500	90.8	-3.2 ±1.4
			÷		1000	94.0	Ref
					2000	94.8	+1.2 ±1.6
					4000	93.8	+1.0 ±1.6
					8000	90.1	-1.1+2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	91.0	-3.0 ±2.0
				2	63	93.3	-0.8 ± 1.5
					125	93.9	-0.2 ±1.5
					250	94.1	-0.0 ± 1.4
30-130	dBC	SPL	Fast	94	500	94.1	-0.0 ± 1.4
				Life.	1000	94.0	Ref
					2000	93.5	-0.2 ± 1.6
					4000	92.0	-0.8 ±1.6
					8000	88.1	-3.0 +2.1: -3.1

Certificate No.: APJ24-111-CC001

Page 3 of 4



5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.15
	63 Hz	± 0.10
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.



Page 4 of 4



Certificate No. 411106

of 2 Pages Page

Customer: Action-UnItod Environmental Services & consulting

Address : Unit A, 20/F, Gold King Industrial Building, 35-41 Tai Lin Pai Road, Kwai Chung, New Territories, Hong Kong

Order No.: Q44140 Date of receipt 25-Oct-24

Item Tested

Description: Sound Calibrator

Manufacturer: B&K I.D. : EQ082 Model : Type 4231 Serial No. : 2713428

Test Conditions

Date of Test: 8-Nov-24 Supply Voltage : --

Ambient Temperature : $(23 \pm 3)^{\circ}C$ Relative Humidity: (50 ± 25) %

Test Specifications

Calibration check.

The UUT has an indication that it conforms to IEC 60942:2017 Class 1.

Ref. Document/Procedure: F21, Z02, IEC 60942:2017.

Test Results

All results were within the IEC 60942 Class 1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No.	Description	Cert. No.	Traceable to
S240	Sound Level Calibrator	405380	NIM-PRC & SCL-HKSAR
S014	Spectrum Analyzer	405219	NIM-PRC & SCL-HKSAR
S041	Universal Counter	402289	SCL-HKSAR
S206	Sound Level Meter	405379	SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI), or by reference to a natural constant. The test results apply to the above Unit-Under-Test only

Calibrated by :

Approved by:

8-Nov-24

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.



Certificate No. 411106

Page 2 of 2 Pages

Results:

1. Generated Sound Pressure Level

UUT Nominal Value (dB)	Measured Value (dB)	IEC 60942 Class 1 Spec.
94.0	94.1	± 0.4 dB
114.0	114.0	

Uncertainty: $\pm 0.2 \text{ dB}$

2. Short-term Level Fluctuation: 0.0 dB

IEC 60942 Class 1 Spec. : \pm 0.1 dB

Uncertainty: ± 0.05 dB

3. Frequency

UUT Nominal Value (kHz)	Measured Value (kHz)	IEC 60942 Class 1 Spec.
1	1.000	± 1 %

Uncertainty: $\pm 3.6 \times 10^{-6}$

4. Total Distortion + Noise: < 0.2 % IEC 60942 Class 1 Spec.: < 3.0 % Uncertainty: ± 2.3 % of reading

Remark: 1. UUT: Unit-Under-Test

2. The uncertainty claimed is for a confidence probability of not less than 95%.

3. Atmospheric Pressure: 1 008 hPa.

----- END -----



Appendix E3

Calibration Certificates for

Water Quality Monitoring Equipment



ALS Technichem (HK) Pty Ltd

HONG KONG

11/F., Chung Shun Knitting Centre,

1 - 3 Wing Yip Street,

Kwai Chung, N.T., Hong Kong

T: +852 2610 1044 F: +852 2610 2021 www.alsglobal.com

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM WORK ORDER: HK2525907

CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES &

ADDRESS: RM A 20/F., GOLD KING IND BLDG, **SUB-BATCH:**

NO. 35-41 TAI LIN PAI ROAD, LABORATORY:

KWAI CHUNG, N.T. **DATE RECEIVED:** 23-Jun-2025 **DATE OF ISSUE:** 03-Jul-2025

GENERAL COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

This report superseded any previous report(s) with same work order number.

EQUIPMENT INFORMATION

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client.

Equipment Type: Multifunctional Meter Service Nature: Performance Check

Scope: Conductivity, Dissolved Oxygen, pH Value, Turbidity, Salinity and Temperature

Brand Name/ Model No.: [YSI]/ [Professional DSS]

Serial No./ Equipment No.: [20J101862/15H103928]/ [EQW018]

Date of Calibration: 26-June-2025

 \mathcal{M}

Ms. Cheng Sin Ying, May Senior Chemist - Inorganics

This report shall not be reproduced except in full without the written approval of the laboratory.

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

WORK ORDER: HK2525907

SUB-BATCH: 0

03-Jul-2025

DATE OF ISSUE: CLIENT:

ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type:

Multifunctional Meter

Brand Name/

[YSI]/ [Professional DSS]

Model No.: Serial No./

Equipment No.:

[20J101862/ 15H103928]/[EQW018]

Date of Calibration:

26-June-2025

Date of Next Calibration:

26-September-2025

PARAMETERS:

Conductivity

Method Ref: APHA (23rd edition), 2510B

Expected Reading (µS/cm)	Displayed Reading (μS/cm)	Tolerance (%)
146.9	151.4	+3.1
6667	6254	-6.2
12890	12908	+0.1
58670	57402	-2.2
	Tolerance Limit (%)	±10.0

Dissolved Oxygen

Method Ref: APHA (23rd edition), 4500O: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
1.96	2.11	+0.15
4.04	4.19	+0.15
7.16	7.19	+0.03
	Tolerance Limit (mg/L)	±0.20

pH Value

Method Ref: APHA (23rd edition), 4500H: B

Expected Reading (pH unit)	Displayed Reading (pH unit)	Tolerance (pH unit)
4.0	4.01	+0.01
7.0	6.92	-0.08
10.0	9.85	-0.15
	Tolerance Limit (pH unit)	±0.20

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Man

Ms. Cheng Sin Ying, May Senior Chemist - Inorganics

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

WORK ORDER: HK2525907

SUB-BATCH: 0

03-Jul-2025

DATE OF ISSUE: CLIENT:

ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type:

Multifunctional Meter

Brand Name/

[YSI]/ [Professional DSS]

Model No.: Serial No./

Equipment No.:

[20J101862/15H103928]/[EQW018]

Date of Calibration:

26-June-2025

Date of Next Calibration:

26-September-2025

PARAMETERS:

Turbidity Method Ref: APHA (23rd edition), 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.42	
4	4.22	+5.5
40	42.32	+5.8
80	77.64	-3.0
400	425.62	+6.4
800	841.24	+5.2
	Tolerance Limit (%)	±10.0

Salinity

Method Ref: APHA (23rd edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.03	
10	9.89	-1.1
20	19.74	-1.3
30	31.03	+3.4
	Tolerance Limit (%)	±10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Man

Ms. Cheng Sin Ying, May Senior Chemist - Inorganics

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

WORK ORDER: HK2525907

SUB-BATCH: 0

DATE OF ISSUE: 03-Jul-2025

CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type:

Multifunctional Meter

Brand Name/ Model No.:

[YSI]/ [Professional DSS]

Serial No./

[20J101862/15H103928]/[EQW018]

Equipment No.: Date of Calibration:

26-June-2025

Date of Next Calibration:

26-September-2025

PARAMETERS:

Temperature Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
12.0	12.0	+0.0
19.5	19.0	-0.5
39.5	38.7	-0.8
	Tolerance Limit (°C)	±2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Man

Ms. Cheng Sin Ying, May Senior Chemist - Inorganics



11/F., Chung Shun Knitting Centre, 1 - 3 Wing Yip Street. Kwai Chung, N.T., Hong Kong

T: +852 2610 1044 F: +852 2610 2021 www.alsglobal.com

WORK ORDER: HK2508901

0

HONG KONG

12-Feb-2025

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM

ACTION UNITED ENVIRONMENT SERVICES AND CLIENT:

CONSULTING

ADDRESS: UNIT A ,20/F., GOLD KING INDUSTRIAL BUILDING,

> NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T. HONG KONG

LABORATORY:

DATE OF ISSUE: 06-Mar-2025

SUB-BATCH:

DATE RECEIVED:

GENERAL COMMENTS

The calibration of flow rate performed by AUES staff on 07 February 2025.

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

This report superseded any previous report(s) with same work order number.

EQUIPMENT INFORMATION

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client.

Equipment Type:

Current Meter

Service Nature:

Performance Check

Scope:

Current

Brand Name/ Model No.:

[Valeport] / [Model 106]

Serial No./ Equipment No.: [60011] / [N/A]

Date of Calibration:

07 February, 2025

Mr. Fung Lim Chee, Richard Managing Director Life Sciences

Hong Kong

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



Work Order:

HK2508901

Sub-batch:

0

Date of Issue:

06-Mar-2025

Client:

ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

Reference Equipment:

Flow Rate

Model:

SonTek IQ Standard

Serial Number:

IQ1217004

Direction

Model:

Magnetic Compass

Equipment to be calibrated:

Equipment Type:

Current Meter

Brand Name/

[Valeport] / [Model 106]

Model No: Serial No./

[60011] / [N/A]

Equipment No.: Date of Calibration:

07 February, 2025

Parameters:

The calibration of current meter is verified with standard flow meter and magnetic compass

on site by AUES Staff.

Flow rate

Trial	Reading of Reference Equipment (m/s) SonTek IQ Standard Serial No: IQ1217004	Reading of Equipment to be calibrated (m/s) Valeport Model 106 Serial No. 60011
1	0.22	0.20
2	0.36	0.35
3	0.54	0.53
4	0.77	0.76
5	0.94	0.93
6	1.06	1.05

Direction

Trial	Reading of Reference Equipment (Degree)	Reading of Equipment to be calibrated (Degree)
mai	Magnetic Compass	Valeport Model 106 Serial No. 60011
1	045	0.45
2	090	091
3	135	136
4	180	182
5	270	271
6	355	356

Mr. Fung Lim Chee, Richard Managing Director, Life Sciences

Hong Kong



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行載於認可範圍內下述測試類別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 28 February 2020

簽發日期:二零二零年二月二十八日

Registration Number: HOKLAS 066

註冊號碼:



Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日



Appendix E4

Calibration Certificates for

LFG Monitoring Equipment





Your Safety Is Our Success

Tel: (852) 2592 2100

Fax: (852) 3165 8960 Email: info@apisehk.com

http://www.apisehk.com

Calibration Certificate

Customer:

Hong Kong Resources Recovery Park

Unit B, 1/F., Hing Yip Centre,31 Hing Yip Street, Kwun Tong, Kowloon, Hong Kong.

Address:

CES 屯門曾咀路

香港九龍觀塘興業街31號興業中心1樓B室

新界西堆填區

Calibration Date:

20/3/2025

Certificate Ref:

GDR02787

Tel:

Fax:

Attn:

Product Name with Model No.: SKY300-R5

Serial No.: 02100C44A2004

Ware version:

V1.2.40

ensor Configurations: LEL/H2S/CO/O2/CO2

Type of Sensor	Serial No.:	State:
Combustible (LEL) Sensor	1	Enable
Hydrogen sulfide (H2S) Sensor	/	Enable
Carbon Monoxide (CO) Sensor	1	Enable
Carbon Dioxide (CO2) Sensor	1	Enable
Oxygen (O2) Sensor	1	Enable

Town of Company		Alarm Setting					
Type of Sensor	Span Calibration -	High	Low	STEL	TWA		
Combustible (LEL) [%]	50	10	5	1	1		
Hydrogen sulfide (H2S) [ppm]	25	15	7	15	10		
Carbon Monoxide (CO) [ppm]	100	75	37	75	25		
Carbon Dioxide (CO2) [ppm]	5000	2000	1500	1	I		
Oxygen (O2) [%]	18	22	19.5	1	1		

Inspection Items	Visual Inspection	Functional Test
Basic Unit - Case & Display etc.	Pass	Pass
Battery and Charge etc.	Pass	Pass
Motorized Pump	Pass	Pass
Audible Alarm and Visual Alarm	Pass	Pass

Gas Detector next annual check due date:

Asia Pacific Industrial Safety Equipment SAFEGAS Authorized Service Centre

Mr. Jason Wong

Sales & Services Department

CERTIFICATION OF CALIBRATION





Certificate Number: G510348_10/36124

No. 66916

Date Of Calibration: 01-Aug-2024

24

Issued by: QED Environmental Systems Inc.

Customer:

ONUEE ELECTRONICS LTD

C3-E TCL SCIENCE PARK NO.1001 ZHONG SHAN YUAN RD. NANSHAN, SHENZHEN 518035

CN

Description:

Model:

GEM5000

Serial Number:

G510348

Accredited Results:

Methane (CH4)

	Methane (CIT-)		
Certified Gas (%)	Instrument Reading (%)	Uncertainty (%)	٦
5.0	4.9	0.42	٦
15.1	15.1	0.66	١
60.0	59.8	1.03	-

Carbon Dioxide (CO2)						
Certified Gas (%)	Instrument Reading (%)	Uncertainty (%)				
5.0	4.9	0.43				
15.0	14.9	0.71				
39.9	40.0	1.19				

	Oxygen (O2)	
Certified Gas (%)	Instrument Reading (%)	Uncertainty (%)
20.9	21.0	0.25

Gas cylinders are traceable and details can be provided if requested.

CH4, CO2 readings recorded at:

32.7 °C/90.9 °F

Barometric Pressure: 0980 mbar/28.94 "Hg

O2 readings recorded at:

23.6 °C/74.4 °F

Method of Test: The analyzer is calibrated in a temperature controlled chamber using a series of reference gases, in compliance with procedure ISP17.

Instrument has passed calibration as the measurement result is within the specification limit. The specification limit takes into account the measurement uncertainty.

The reported expanded uncertainty is based on a standard uncertainty multiplied by a coverage factor of k=2, providing a level of confidence of approximately 95%. The uncertainty evaluation has been carried out in accordance with NIST requirements.

The calibration results published in this certificate were obtained using equipment capable of producing results that are traceable through NIST to the International System of Units (SI). Certification only applies to results shown. This certificate may not be reproduced other than in full, except with the prior written approval of the issuing laboratory.

Calibration Instance: 118

IGC Instance: N/A

Page 1 of 3 | LP015LNANIST-1.1

www.gedenv.com

(800) 624-2026

info@gedenv.com

QED Environmental Systems Inc. 2355 Bishop Circle West, Dexter, MI 48130

CERTIFICATION OF CALIBRATION





Certificate Number: G510348_10/36124

Date Of Calibration: 01-Aug-2024

Issued by: QED Environmental Systems Inc.

Non Accredited results:

Pressure Transducers (inches of water column)							
Transducer Certified (Low) Reading (Low) Certified (High) Reading (High) Accu							
Static	0"	0"	40"	40.03"	2.0"		
Differential	0"	0"	4"	3.99"	0.7"		

Baromet	ter (mbar)
Reference	Instrument Reading
0980 mbar / 28.94 "Hg	0981 mbar / 28.98 "Hg

Date of Issue: 02 Aug 2024

Approved By Signatory

Carson Bins

Laboratory Inspection

The calibration results published in this certificate were obtained using equipment capable of producing results that are traceable through NIST to the International System of Units (SI). Certification only applies to results shown. This certificate may not be reproduced other than in full, except with the prior written approval of the issuing laboratory.

Calibration Instance: 118

IGC Instance: N/A

Page 3 of 3 | LP015LNANIST-1.1



Appendix F

Meteorological Data



				Lau Fau Shan Station			
Date		Weather	Total Rainfall (mm)	Mean Air Temperature (°C)	Wind Speed (km/h)	Mean Relative Humidity (%)	Wind Direction
1-Jul-25	Tue	Sunny periods and a few showers.	5.5	27.8	15.7	88.7	Е
2-Jul-25	Wed	Hot. Moderate east to southeasterly winds.	0.5	29.8	16.7	82	Е
3-Jul-25	Thu	Mainly fine apart from isolated showers. Very hot.	0	30.4	12.7	80.7	E/NE
4-Jul-25	Fri	Very hot. Moderate east to northeasterly winds.	0	30.9	13.2	73	Е
5-Jul-25	Sat	Sunny periods and a few showers.	3.7	30.8	13.2	81.2	N/NW
6-Jul-25	Sun	Very hot. Isolated thunderstorms later.	0	30.5	17.5	77.2	W/SW
7-Jul-25	Mon	Very hot with sunny periods	0	31.5	15.7	80.7	W/SW
8-Jul-25	Tue	Very hot with sunny periods.	0	31.2	21.2	80	W/SW
9-Jul-25	Wed		15.2	30.2	17	77.5	W/SW
10-Jul-25	Thu	Mainly cloudy with occasional showers and squally thunderstorms.	126.4	25.7	18.5	98.7	SW
11-Jul-25	Fri	Mainly cloudy with a few showers.	0	27.3	10.5	91.2	W/SW
12-Jul-25	Sat	More showers with a few squally thunderstorms	38.4	28.5	12	93	S/SE
13-Jul-25	Sun	Sunny periods and a few showers.	1.9	29.8	14	83	S/SE
14-Jul-25	Mon	Very hot. Moderate southwesterly winds.	9.2	30.3	15	84.5	W/SW
15-Jul-25	Tue	Sunny periods. Very hot.	3.2	31.3	17.2	81.7	W/SW
16-Jul-25	Wed		0	30.7	15.5	82.5	W/SW
17-Jul-25	Thu	Mainly fine. Extremely hot with isolated showers	0	31.7	14.2	78.7	W/SW
18-Jul-25	Fri	Mainly cloudy and very hot with sunny intervals.	19	29.1	19.5	89.5	S/SE
19-Jul-25	Sat	Moderate to fresh southeasterly winds.	10	29.7	18.5	82.5	N/NW
20-Jul-25	Sun	Cloudy with occasional showers and squally thunderstorms.	87.6	26.1	40.7	98	E/SE
21-Jul-25	Mon	Moderate to fresh southeasterly winds.	42.4	27	20	91	E/SE
22-Jul-25	Tue	Mainly cloudy with a few showers	95.7	28.2	8	88	S/SE
23-Jul-25	Wed		2.6	29.8	14.2	81.2	Е
24-Jul-25	Thu	Mainly fine. Very hot	Trace	297	15.5	80	W/SW
25-Jul-25	Fri	Mainly fine. Very hot	31.8	29.6	12.5	81	W/SW
26-Jul-25	Sat	More showers with thunderstorms later.	0	29.2	8	82.5	W/SW
27-Jul-25	Sun	Moderate southwesterly winds.	0	30.5	15.5	79.2	W/SW
28-Jul-25	Mon	Sunny intervals and a few showers. Very hot	0.6	29.7	2.5	85.7	W/SW
29-Jul-25	Tue	Mainly cloudy with occasional	106.5	30.1	13	86.5	W/SW

Contract No. EP/SP/186/21 West New Territories Landfill Extension Monthly Environmental Monitoring & Audit Report – July 2025



		showers and squally thunderstorms.					
30-Jul-25	Wed	Mainly cloudy with a few	0	30.5	16.2	86.2	W/SW
		showers.					
31-Jul-25	Thu	Mainly cloudy and hot.	1.5	27.9	11.5	92.5	S/SW



Appendix G

Event and Action Plan



Event / Action Plan for Air Quality

Event	Action		•	
Event	ET	IEC	SM	Contractor
Action level exceedance for one sample	Identify source Inform IEC, SM and Contractor Repeat measurements to confirm findings. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily	1. Check monitoring data and Contractor's working methods	Notify Contractor for the identification of cause	Rectify any unacceptable practice Amend working methods if appropriate
Action level exceedance for two or more consecutive samples	I. Identify source Notify IEC, SM and Contractor Repeat measurements to confirm findings. Investigate the cause of exceedance and check Contractor's working procedures If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily. Discuss with IEC and SM on remedial actions required If exceedance continues, arrange meeting with IEC and Contractor If exceedance stops, cease additional monitoring.	1. Review monitoring data submitted by ET 2. Review the investigation finding submitted by ET and check the Contractor's working method 3. Review the proposed remedial measures by Contractor and advise SM accordingly 4. Supervise Implementatio n of remedial measures.	Confirm receipt of notification of exceedance in writing Require Contractor to propose remedial measures for the analysed dust problem Ensure remedial measures properly implemented.	1. Rectify any unacceptable practice 2. Amend working methods if appropriate 3. Submit proposals for remedial actions to IEC within 3 working days of notification 4. Implement the agreed proposals 5. Amend proposal if appropriate.
Limit level exceedance for one sample	Identify source Inform IEC, SM and Contractor Repeat measurements to confirm findings. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SM informed of the results	Review monitoring data submitted by ET Discuss among st SM, ET Leader and Contractor on the potential remedial actions. Supervise the implementation of remedial measures	Confirm receipt of notification of exceedance in writing Require Contractor to propose remedial measures for the analysed dust problem Ensure remedial measures properly implemented	1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IEC within 3 working days of notification 3. Implement the agreed proposals 4. Amend proposal if appropriate
Limit level exceedance for two or more consecutive samples	Identify source Repeat measurements to confirm findings Inform IEC, SM, Contractor and EPD Investigate the cause of exceedance and carry out analysis of Contractor's	Review monitoring data submitted by ET Discuss amon gst SM, ET Leader and Contractor on	Confirm receipt of notification of exceedance in writing Require Contractor to propose remedial	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working



Event	Action			
Event	ET	IEC	SM	Contractor
	working procedures to determine possible mitigation to be implemented 5. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily. 6. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SM informed of the results 7. If exceedance continues, arrange meeting with IEC and Contractor 8. If exceedance stops, cease additional monitoring.	the potential remedial actions. 3. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise SM accordingly 4. Supervise the implementation of remedial measures.	measures for the analysed dust problem 3. Ensure remedial measures properly implemented; 4. If exceedance continues, consider what activity of the work is responsible and instruct Contractor to stop that activity of work until the exceedance is abated	days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker SM – Service Manager



Event / Action Plan for Construction Noise

	EVENT / ACTION FIRM for Construction Noise								
Event	ET	IEC	SM	Contractor					
Exceedance of Action Level	Identify source, investigate the causes of exceedance and propose remedial measures; Notify IEC and Contractor; Report the results of investigation to IEC, SM and Contractor; Discuss with Contractor and formulate remedial measures; If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to check mitigation effectiveness.	Review the analysed results submitted by ET; Review the proposed Remedial measures by Contractor and advise SM accordingly; Supervise the implementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented.	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.					
Exceedance of Limit Level	Identify source; Inform IEC, SM, EPD and Contractor; Repeat measurements to confirm findings; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency; Inform IEC, SM and EPD the causes and actions taken for exceedance; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SM informed of the results; If exceedance stops, cease additional monitoring.	Discuss amongst SM, ET, and Contractor on the potential remedial actions; Review Contractor remedial actions whenever necessary to assure their effectiveness and advise SM accordingly; Supervise implementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct Contractor to stop that portion of works until the exceedance is abated.	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by SM until the exceedance is abated.					

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager



Event / Action Plan for Water Quality

Event	ET	IEC	SM	Contractor
Action level being exceeded by one sampling day	 Identify source(s) of impact; Inform IEC, Contractor; Check monitoring data, all plant, equipment and Contractor's working methods. 	Check monitoring data and Contractor's working methods.	Confirm receipt of notification of non-compliance in writing; and Notify Contractor.	
Action level being exceeded by two or more consecutive sampling days	Identify source(s) of impact; Inform IEC, Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Ensure mitigation measures are implemented; If the exceedance is confirmed to be Project related after investigation, increase the monitoring frequency to daily until no exceedance of Action level	data and Contractor's working method; • Discuss with ET and Contractor on possible remedial actions; • Review the proposed mitigation measures; and	measures are properly implemented; and • Assess the	 Rectify unacceptable practice; Check all plant and equipment and consider changes of working methods; Submit proposal of additional mitigation measures to IEC within 3 working days of notification; and Implement the agreed mitigation measures.
Limit level being exceeded by one sampling day	 Identify source(s) of impact; Inform IEC, SM and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, SM and Contractor; Ensure mitigation measures are implemented; and If the exceedance is confirmed to be Project related after investigation, repeat measurement on next day of exceedance. 	data submitted by ET and Contractor's working method; • Discuss with ET and Contractor on possible remedial actions; • Review the proposed mitigation	measures; • Request Contractor to review the	 Take immediate corrective actions to avoid further exceedance; Submit proposal of mitigation measures to IEC within 3 working days; Implement the agreed mitigation measures; Submit further mitigation measures if problem still not under control;



_				
Event	ET	IEC	SM	Contractor
Limit level being exceeded by two or more consecutive sampling days	mioni iec, sin, ei b	data submitted by ET and Contractor's working method; Discuss with ET and Contractor on possible remedial actions; • Review the • Contractor's mitigation measures • whenever • necessary to assure their effectiveness; • Supervise the implementation of mitigation measures.	ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures and ensure mitigation measures are properly implemented;	corrective actions to avoid further exceedance; • Submit proposal of mitigation measures to IEC within 3 working days; • Implement the agreed mitigation measures; Resubmit proposals if problem still not under control; • Slow down or to stop relevant activity until

Notes:

ET – Environmental Team IEC – Independent Environmental Checker SM – Service Manager



Event and action plan for landscape and visual monitoring during Construction

	ET	IEC	SM	Contractor
Design checking	Check final design conforms to the requirements of EP and prepare report	Check report. Recommend remedial design if necessary	Undertake remedial design if necessary	Ensure compliance with EP requirements
Exceedance on one occasion	Identify source of impact Inform IEC and SM Discuss remedial actions with IEC, SM and Contractor Monitor remedial actions until rectification has been completed	Check monitoring report Check Contractor's working method Discuss with ET and Contractor on possible remedial measures Advise SM on effectiveness of proposed remedial measures Check implementation of remedial measures	Notify Contractor Ensure remedial measures are properly implemented	Amend working methods Rectify damage and undertake any necessary replacement
Repeated Exceedance(s)	Identify source of impact Inform IEC and SM Increase monitoring frequency Discuss remedial actions with IEC, SM and Contractor Monitor remedial actions until rectification has been completed If exceedance stops, cease additional monitoring	Check monitoring report Check Contractor's working method Discuss with ET and Contractor on possible remedial measures Advise SM on effectiveness of proposed remedial measures Supervise implementation of remedial measures	Notify Contractor Ensure remedial measures are properly implemented	Amend working methods Rectify damage and undertake any necessary replacement

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager



Appendix H

Monitoring Schedule



Impact Monitoring Schedule for July 2025

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1	Noise 2	3 1-Hr TSP X3 24-Hr TSP	4	5 1-Hr TSP X3 24-Hr TSP
6	7	8 Noise	9 1-Hr TSP X3 24-Hr TSP	10	11 1-Hr TSP X3 24-Hr TSP	12
13	Noise 14	15 1-Hr TSP X3 24-Hr TSP	16 Surface Water	17 1-Hr TSP X3 24-Hr TSP	18	19
20	21	22 Noise	23 1-Hr TSP X3 24-Hr TSP	24	25 1-Hr TSP X3 24-Hr TSP	26
27	28 Noise	29 1-Hr TSP X3 24-Hr TSP	30	31 1-Hr TSP X3 24-Hr TSP		



Impact Monitoring Schedule for August 2025

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
					1	2
3	4	5	6	7	8	9
	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP Noise			1-Hr TSP X3 24-Hr TSP
10	11	12	13	14	15	16
	Noise	1-Hr TSP X3 24-Hr TSP	Surface Water		1-Hr TSP X3 24-Hr TSP	
17	18	19	20	21	22	23
	1-Hr TSP X3 24-Hr TSP		Noise	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP
24	25	26	27	28	29	30
		Noise	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP	
31						



Appendix I

Detailed Monitoring Results



Construction Dust Monitoring Results

Location: AM(D)1

		1-	hour TSP (µg/m³)		Action	Limit
Date	Start Time	1 st reading	2 nd reading	3 rd reading	Level (μg/m³)	Level(µg/m³)
3-Jul-25	11:28	34	44	42	317	500
5-Jul-25	11:30	51	59	70	317	500
9-Jul-25	11:30	124	104	98	317	500
11-Jul-25	15:27	64	57	44	317	500
15-Jul-25	11:30	85	98	98	317	500
17-Jul-25	11:28	51	44	57	317	500
23-Jul-25	11:30	44	36	52	317	500
25-Jul-25	11:33	41	31	48	317	500
29-Jul-25	11:30	104	112	116	317	500
31-Jul-25	11:33	49	59	57	317	500

Location: AM(D)2

			hour TSP (µg/m³)		Action	Limit
Date	Start Time	1 st reading	2 nd reading	3 rd reading	Level (µg/m³)	Level(µg/m³)
3-Jul-25	11:00	39	46	43	313	500
5-Jul-25	11:02	44	38	56	313	500
9-Jul-25	10:55	89	60	64	313	500
11-Jul-25	14:55	51	42	53	313	500
15-Jul-25	10:55	59	56	47	313	500
17-Jul-25	11:00	56	44	59	313	500
23-Jul-25	11:05	51	40	53	313	500
25-Jul-25	11:00	44	38	49	313	500
29-Jul-25	11:03	41	32	51	313	500
31-Jul-25	11:00	87	99	86	313	500

Location: AM(D)3

	1-hour TSP (μg/m³)			Action	Limit	
Date	Start Time	1 st reading	2 nd reading	3 rd reading	Level (µg/m³)	Limit Level(µg/m³)
3-Jul-25	10:32	84	77	65	334	500
5-Jul-25	10:30	95	88	101	334	500
9-Jul-25	10:25	41	31	39	334	500
11-Jul-25	14:27	55	71	81	334	500
15-Jul-25	10:30	69	71	51	334	500
17-Jul-25	10:33	73	81	61	334	500
23-Jul-25	10:30	65	84	71	334	500
25-Jul-25	10:27	61	75	51	334	500
29-Jul-25	10:31	131	124	121	334	500
31-Jul-25	10:25	61	91	71	334	500



Location: AM(D)5a

	1-hour TSP (μg/m³)			Action	Limit	
Date	Start Time	1st reading	2 nd reading	3 rd reading	Level (µg/m³)	Limit Level(µg/m³)
3-Jul-25	09:01	273	257	277	371	500
5-Jul-25	08:53	163	189	193	371	500
9-Jul-25	08:55	257	277	281	371	500
11-Jul-25	13:00	149	173	179	371	500
15-Jul-25	08:55	107	131	139	371	500
17-Jul-25	09:00	149	135	123	371	500
23-Jul-25	08:54	245	261	265	371	500
25-Jul-25	08:58	153	169	175	371	500
29-Jul-25	08:55	249	265	285	371	500
31-Jul-25	08:47	177	189	191	371	500

Location: AM(D)6a

		1-	hour TSP (µg/m³)		Action	Limit
Date	Start Time	1 st reading	2 nd reading	3 rd reading	Level (µg/m³)	Level(µg/m³)
3-Jul-25	09:27	51	45	63	294	500
5-Jul-25	09:30	72	91	101	294	500
9-Jul-25	09:28	162	176	183	294	500
11-Jul-25	13:28	68	83	91	294	500
15-Jul-25	09:31	62	74	83	294	500
17-Jul-25	09:28	156	168	180	294	500
23-Jul-25	09:31	51	62	72	294	500
25-Jul-25	09:27	58	74	74	294	500
29-Jul-25	09:30	62	82	78	294	500
31-Jul-25	09:25	68	93	82	294	500

Location: AM(D)7a

		1-	hour TSP (µg/m³)		Action	Limit
Date	Start Time	1 st reading	2 nd reading	3 rd reading	Level (μg/m³)	Limit Level(µg/m³)
3-Jul-25	10:01	84	73	89	331	500
5-Jul-25	10:00	204	249	213	331	500
9-Jul-25	10:04	246	254	249	331	500
11-Jul-25	14:00	109	117	113	331	500
15-Jul-25	10:01	52	43	41	331	500
17-Jul-25	09:55	149	148	138	331	500
23-Jul-25	10:02	87	87	77	331	500
25-Jul-25	10:05	83	87	91	331	500
29-Jul-25	10:02	191	212	233	331	500
31-Jul-25	10:00	37	54	43	331	500



							24- H	lour TSP N	Monitoring 1	Data for AM(D))1						
DATE	SAMPLE NUMBER	EL	APSED TI	ME	CHAR	T REA	DING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME		WEIGHT g)	DUST WEIGHT COLLECTED	24-hr TSP (μg/m³)	Action Level	Limit
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)			Level
3 Jul 25	21579	21412.55	21436.55	1440.00	32	32	32.0	30.5	1007.5	0.89	1284	2.6971	2.7192	0.0221	17	155	260
5 Jul 25	21706	21436.55	21460.55	1440.00	40	40	40.0	30.6	1003.3	1.16	1673	2.6886	2.7740	0.0854	51	155	260
9 Jul 25	21705	21460.55 21484.55 1440.00		44	44	44.0	30.7	1000	1.30	1866	2.7146	2.9372	0.2226	119	155	260	
11 Jul 25	21597	21484.55	21508.55	1440.00	44	44	44.0	27.9	998.9	1.30	1875	2.6969	2.7698	0.0729	39	155	260
15 Jul 25	21719	21508.55	21532.55	1440.00	44	44	44.0	30.3	1003.5	1.30	1871	2.7436	2.8734	0.1298	69	155	260
17 Jul 25	21725	21532.55	21556.55	1440.00	42	42	42.0	31.3	1003.1	1.23	1769	2.7450	2.8217	0.0767	43	155	260
23 Jul 25	21731	21556.55	21580.55	1440.00	40	40	40.0	29	1003.2	1.17	1679	2.7708	2.8126	0.0418	25	155	260
25 Jul 25	21742	21580.55	21604.55	1440.00	38	38	38.0	29.2	1000.1	1.09	1577	2.7829	2.8298	0.0469	30	155	260
29 Jul 25	21751	21604.55	21628.55	1440.00	40	40	40.0	27.8	996.9	1.16	1676	2.7689	2.9280	0.1591	95	155	260
31 Jul 25	21758	21628.55	21652.55	1440.00	38	38	38.0	29.9	998.6	1.09	1573	2.5872	2.6519	0.0647	41	155	260

							24-H	our TSP N	Aonitoring I	Data for AM(D)	2						
DATE	SAMPLE NUMBER	EL.	APSED TI	ME	CHAI	RT REA	DING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME		WEIGHT g)	DUST WEIGHT COLLECTED	24-hr TSP (μg/m³)	Action Level	Limit
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)			Level
3 Jul 25	21574	10302.55	10326.55	1440.00	32	32	32.0	30.3	1007.5	0.99	1422	2.7100	2.7412	0.0312	22	156	260
5 Jul 25	21592	10326.55	10350.55	1440.00	30	30	30.0	30.6	1003.3	0.92	1330	2.6919	2.7290	0.0371	28	156	260
9 Jul 25	21704	10350.55	10374.55	1440.00	39	39	39.0	30.7	1000	1.20	1721	2.6902	2.7693	0.0791	46	156	260
11 Jul 25	21713	10374.55	10398.55	1440.00	40	40	40.0	27.9	998.9	1.23	1772	2.7367	2.7829	0.0462	26	156	260
15 Jul 25	21720	10398.55	10422.55	1440.00	38	38	38.0	30.3	1003.5	1.17	1681	2.7389	2.7859	0.0470	28	156	260
17 Jul 25	21724	10422.55	10446.55	1440.00	38	38	38.0	31.3	1003.1	1.17	1678	2.7443	2.8069	0.0626	37	156	260
23 Jul 25	21732	10446.55	10470.55	1440.00	39	39	39.0	29	1003.2	1.20	1729	2.7515	2.8265	0.0750	43	156	260
25 Jul 25	21744	10470.55	10494.55	1440.00	35	35	35.0	29.2	1000.1	1.08	1550	2.7686	2.8125	0.0439	28	156	260
29 Jul 25	21752	10494.55	10518.55	1440.00	40	40	40.0	27.8	996.9	1.23	1770	2.7486	2.8541	0.1055	60	156	260
31 Jul 25	21754	10518.55	10542.55	1440.00	32	32	32.0	29.9	998.6	0.98	1416	2.7661	2.8343	0.0682	48	156	260



							24-H	Iour TSP	Monitoring	Data for AM(D)3						
DATE	SAMPLE NUMBER		APSED TI	ME	CHAl	RT REA	DING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME		WEIGHT g)	DUST WEIGHT COLLECTED	24-hr TSP (μg/m³)	Action Level	Limit
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)			Level
3 Jul 25	21578	22514.75	22538.75	1440.00	30	30	30.0	30.3	1007.5	0.85	1225	2.7037	2.7462	0.0425	35	155	260
5 Jul 25	21594	22538.75	22562.75	1440.00	36	36	36.0	30.6	1003.3	1.06	1532	2.7128	2.8388	0.1260	82	155	260
9 Jul 25	21715	22562.75	22586.75	1440.00	36	36	36.0	30.7	1000	1.06	1529	2.7491	2.7730	0.0239	16	155	260
11 Jul 25	21714	22586.75	22610.75	1440.00	34	34	34.0	27.9	998.9	0.99	1432	2.7487	2.8176	0.0689	48	155	260
15 Jul 25	21718	22610.75	22634.75	1440.00	34	34	34.0	30.3	1003.5	0.99	1429	2.7393	2.8040	0.0647	45	155	260
17 Jul 25	21727	22634.75	22658.75	1440.00	34	34	34.0	31.3	1003.1	0.99	1426	2.7230	2.7993	0.0763	53	155	260
23 Jul 25	21730	22658.75	22682.75	1440.00	38	38	38.0	29	1003.2	1.14	1641	2.7566	2.8572	0.1006	61	155	260
25 Jul 25	21741	22682.75	22706.75	1440.00	38	38	38.0	29.2	1000.1	1.14	1637	2.7685	2.8179	0.0494	30	155	260
29 Jul 25	21748	22706.75	22730.75	1440.00	40	40	40.0	27.8	996.9	1.21	1742	2.7536	2.9457	0.1921	110	155	260
31 Jul 25	21746	22730.75	22754.75	1440.00	34	34	34.0	29.9	998.6	0.99	1426	2.7629	2.8371	0.0742	52	155	260

							24-H	lour TSP l	Monitoring	Data for AM(D)5a						
DATE	SAMPLE NUMBER	ELAPS	SED TI	ME	CHAI	RT REA	DING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME		WEIGHT g)	DUST WEIGHT COLLECTED	24-hr TSP (μg/m³)	Action Level	Limit
		INITIAL FI	INAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)			Level
3 Jul 25	21576	4239.31 42	263.31	1440.00	44	44	44.0	30.3	1007.5	1.36	1953	2.6988	3.1210	0.4222	216	238	260
5 Jul 25	21590	4263.31 42	287.31	1440.00	40	40	40.0	30.6	1003.3	1.22	1757	2.7036	2.9662	0.2626	149	238	260
9 Jul 25	21596	4287.31 43	11.31	1440.00	48	48	48.0	30.7	1000	1.48	2133	2.7108	3.2074	0.4966	233	238	260
11 Jul 25	21712	4311.31 433	35.31	1440.00	46	46	46.0	27.9	998.9	1.42	2047	2.7360	2.9520	0.2160	106	238	260
15 Jul 25	21717	4335.31 43	59.31	1440.00	42	42	42.0	30.3	1003.5	1.29	1853	2.7375	2.9038	0.1663	90	238	260
17 Jul 25	21729	4359.31 43	883.31	1440.00	40	40	40.0	31.3	1003.1	1.22	1755	2.7444	2.9195	0.1751	100	238	260
23 Jul 25	21734	4383.31 44	07.31	1440.00	46	46	46.0	29	1003.2	1.42	2048	2.7451	3.2129	0.4678	228	238	260
25 Jul 25	21736	4407.31 443	31.31	1440.00	46	46	46.0	29.2	1000.1	1.42	2044	2.7403	2.9943	0.2540	124	238	260
29 Jul 25	21753	4431.31 44	55.31	1440.00	46	46	46.0	27.8	996.9	1.42	2045	2.7603	3.2106	0.4503	220	238	260
31 Jul 25	21756	4455.31 44	79.31	1440.00	42	42	42.0	29.9	998.6	1.28	1850	2.7541	3.0671	0.3130	169	238	260



							24-Но	our TSP M	Ionitoring D	ata for AM(D)	6a						
DATE	SAMPLE NUMBER	EL	APSED TI	ME	СНАГ	RT REA	DING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME		WEIGHT g)	DUST WEIGHT COLLECTED	24-hr TSP (μg/m³)		Limit
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)			Level
3 Jul 25	21577	22240.98	22264.98	1440.00	40	40	40.0	30.3	1007.5	1.34	1931	2.6907	2.7654	0.0747	39	159	260
5 Jul 25	21591	22264.98	22288.98	1440.00	40	40	40.0	30.6	1003.3	1.34	1926	2.6980	2.8064	0.1084	56	159	260
9 Jul 25	21701	22288.98	22312.98	1440.00	40	40	40.0	30.7	1000	1.34	1923	2.6873	2.9213	0.2340	122	159	260
11 Jul 25	21711	22312.98	22336.98	1440.00	40	40	40.0	27.9	998.9	1.34	1931	2.7372	2.8137	0.0765	40	159	260
15 Jul 25	21716	22336.98	22360.98	1440.00	40	40	40.0	30.3	1003.5	1.34	1927	2.7596	2.8806	0.1210	63	159	260
17 Jul 25	21728	22360.98	22384.98	1440.00	42	42	42.0	31.3	1003.1	1.40	2021	2.7329	3.0093	0.2764	137	159	260
23 Jul 25	21735	22384.98	22408.98	1440.00	44	44	44.0	29	1003.2	1.48	2127	2.7512	2.8714	0.1202	57	159	260
25 Jul 25	21745	22408.98	22432.98	1440.00	42	42	42.0	29.2	1000.1	1.41	2025	2.7728	2.8846	0.1118	55	159	260
29 Jul 25	21750	22432.98	22456.98	1440.00	44	44	44.0	27.8	996.9	1.48	2125	2.7590	2.8688	0.1098	52	159	260
31 Jul 25	21757	22456.98	22480.98	1440.00	42	42	42.0	29.9	998.6	1.40	2021	2.5931	2.6994	0.1063	53	159	260

							24-H	lour TSP I	Monitoring 1	Data for AM(D)7a						
DATE	SAMPLE NUMBER		APSED TI	ME	СНАІ	RT REA	DING	AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER (WEIGHT g)	DUST WEIGHT COLLECTED	24-hr TSP (μg/m³)	Action Level	Limit
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m ³)	INITIAL	FINAL	(g)			Level
3 Jul 25	21575	3879.01	3903.01	1440.00	40	40	40.0	30.3	1007.5	1.23	1769	2.6980	2.8169	0.1189	67	215	260
5 Jul 25	21595	3903.01	3927.01	1440.00	42	42	42.0	30.6	1003.3	1.30	1873	2.7032	3.0657	0.3625	194	215	260
9 Jul 25	21702	3927.01	3951.01	1440.00	46	46	46.0	30.7	1000	1.45	2087	2.6721	3.0952	0.4231	203	215	260
11 Jul 25	21710	3951.01	3975.01	1440.00	40	40	40.0	27.9	998.9	1.23	1768	2.7541	2.8686	0.1145	65	215	260
15 Jul 25	21721	3975.01	3999.01	1440.00	34	34	34.0	30.3	1003.5	1.00	1437	2.7328	2.7809	0.0481	33	215	260
17 Jul 25	21726	3999.01	4023.01	1440.00	36	36	36.0	31.3	1003.1	1.07	1542	2.7342	2.9063	0.1721	112	215	260
23 Jul 25	21733	4023.01	4047.01	1440.00	34	34	34.0	29	1003.2	1.00	1440	2.7482	2.8290	0.0808	56	215	260
25 Jul 25	21743	4047.01	4071.01	1440.00	34	34	34.0	29.2	1000.1	1.00	1437	2.7711	2.8820	0.1109	77	215	260
29 Jul 25	21749	4071.01	4095.01	1440.00	38	38	38.0	27.8	996.9	1.15	1657	2.7577	3.0615	0.3038	183	215	260
31 Jul 25	21755	4095.01	4119.01	1440.00	36	36	36.0	29.9	998.6	1.07	1542	2.7836	2.8314	0.0478	31	215	260



Construction Noise Monitoring Results

Location: NM1 (Daytime Period)

Date	Start Time	1 st Leq _{5min}	L10	L90	2 nd Leq _{5min}	L10	L90	3 rd Leq _{5min}	L10	L90	4 th Leq _{5min}	L10	L90	5 th Leq _{5min}	L10	L90	6 th Leq _{5min}	L10	L90	Leq30min	Façade Correction	Limit Level
2-Jul-25	15:15	51.4	52.0	44.5	48.8	51.0	44.0	54.3	57.5	48.0	56.7	59.0	48.0	54.2	57.0	48.0	57.6	61.5	48.5	55	58	75
8-Jul-25	15:35	54.5	57.5	47.0	57.2	58.0	48.5	59.0	62.5	49.5	55.3	58.5	48.5	58.2	61.5	48.5	57.2	59.5	49.0	57	60	75
14-Jul-25	16:35	52.7	56.0	45.5	55.0	58.5	48.0	52.2	55.0	47.0	51.2	54.0	45.0	50.1	52.5	45.0	49.7	53.0	44.5	52	55	75
22-Jul-25	16:00	48.1	49.5	41.5	45.2	47.0	41.0	48.7	50.0	42.5	46.5	48.0	41.5	48.2	51.0	42.5	47.8	48.5	43.0	48	51	75
28-Jul-25	17:00	51.3	53.0	44.5	57.4	59.5	46.0	56.6	60.0	48.0	57.9	60.0	49.0	53.3	56.0	47.5	55.0	56.0	46.5	56	59	75

Remark: façade correction (+3 dB(A) was added according to acoustical principles and EPD guidelines



Surface Water Quality Monitoring Results Location: WM1

Date	Time	Tide	Depth (m)	Speed of Water Flow (m/s)	Direction of Water Flow (degree)	Temj	y (℃)	D((mg		DOS	(%)	Turbi (NT	•	Sali (p _l		pI	H	Condu	ıctivity	Suspe Sol (mg	ids
16-Jul-25	16:30	Ebb	1.30	0.066	203.50	30.7	30.8	6.48	6.5	90.1	90.5	7.86	8.1	17.49	17.48	7.82	70	31678	31678	10.0	10.0
10-341-23	10.30		1.30	0.000	203.30	30.8	30.8	6.52	0.3	90.9	90.3	8.40	0.1	17.47	17.40	7.81	7.8	31678	310/6	10.0	
16-Jul-25	10:09	Flood	1.20	0.069	287.80	29.4	29.4	6.71	6.7	91.8	02.0	19.80	19.7	17.45	17.42	7.66	77	30832	30783	24.0	22.0
10-341-23	10:09		1.20	0.009	207.00	29.4	∠9.4	6.73	0.7	92.1	92.0	19.54	19./	17.39	17.42	7.65	/./	30733	30/83	21.9	23.0

	tal linity g/L)	Sulphate (mg/L)		oride g/L)		mium g/L)	Сор (µg/		Le (µg		Mang (μg		Nic (µg		Zi (µg			cium g/L)	Ir (µg	on g/L)		esium g/L)		ssium g/L)	Sodium	ı (μg/L)
92	01.5	1110	9140	9230.0	0.90	0.6	3.00	2.5	<1	1.0	22.00	22.0	1.0	1.0	11.0	<10	243000	248000	240	245	574000	578000	176000	177000	4220000	4240000
91	91.5	1090	9320	9230.0	0.30	0.0	4.00	ر.	1.0	1.0	22.00	22.0	1.0	1.0	<10	\10	253000	24000	250	243	582000	378000	178000	177000	4260000	
91	91.5	1120 1135.0	9600	9680.0	1.20	1.0	7.00	7.0	2.0	2.0	46.00	45.5	1.0	1.5	22.0	22.5	245000	244500	630	645	591000	591000	178000	178000	4260000	1265000
92		1150	9760		0.80		7.00		2.0		45.00		2.0		23.0		244000		660		591000		178000		4270000	4265000

Ammo N (m	onia as ng/L)		rate as ng/L)	Kje Nitro	otal ldahl ogen as ng/L)	Phosph	active orus as P g/L)	Sulphite	e (mg/L)		Organic (mg/L)	Oil Gre (mg	ase	Chemica Demand (mg	,	Diocii	emical ı (mg/L)	Total Coliform (C	FU/100mL)
< 0.01	< 0.01	0.94	0.940	0.3	0.30	0.04	0.040	<2	/2	<5	-5	<5	-5	<20	<20	<2	<2	56	51.5
< 0.01	\0.01	0.94	0.940	0.3	0.30	0.04	0.040	<2	<2	<5	<5	<5	<5	<20	\ 20	<2	~2	47	51.5
< 0.01	< 0.01	1.00	1.030	0.2	0.20	0.05	0.050	<2	<2	<5	<5	< 5	<5	<20	<20	<2	<2	16	15.5
< 0.01		1.06		0.2		0.05		<2		<5		<5		<20		<2		15	13.3



Contract No.: EP/SP/186/21

Name of construction site: West New Territories Landfill Extension Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	1-Aug-24
SKY3000 Series (LEL)	20-Mar-25

Monitoring of Excavation									
Date of measurement	Sample location	Sampling time	Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (*C)	Remark
1-Jul-25	C1	8: 40	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	B2	8: 51	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	B9	9: 12	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	B10	9: 24	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	B1a	9: 40	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	B1c	9: 52	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	A1	10: 14	Cloudy	0.0%	0	20.2	0%LEL	28.2°C	
1-Jul-25	C1	13 : 29	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	
1-Jul-25	B2	13 : 50	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	
1-Jul-25	B9	14: 11	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	
1-Jul-25	B10	14: 37	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	4
1-Jul-25	B1a	15: 10	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	
1-Jul-25	B1c	15: 22	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	
1-Jul-25 2-Jul-25	A1	15 : 36	Cloudy	0.0%	0	20.2	0%LEL	29.8°C	
2-Jul-25 2-Jul-25	C1	B : 41	Sunny	0.0%	0	20.5	0%LEL	30°C	
2-Jul-25	B2 B9	9: 16	Sunny	0.0%	0	20.5	0%LEL	30°C	-
2-Jul-25	B10	9: 39	Sunny	0.0%	0	20.5	0%LEL	30°C	
2-Jul-25	B1a	9: 52	Sunny	0.0%		20.5	0%LEL	30°C	
2-Jul-25	B1c	10 : 14 10 : 28	Sunny	0.0%	0	20.5 20.5	0%LEL	30°C	
2-Jul-25							0%LEL		
2-Jul-25	A1 C1	10: 46	Sunny	0.0%	0	20.5 20.5	0%LEL	33.3℃	
2-Jul-25	B2	13 : 30 13 : 51	Sunny	0.0%	0	20.5	0%LEL	33.3℃ 33.3℃	
2-Jul-25	B9	14: 22	Sunny	0.0%	0	20.5	0%LEL	33.3℃	
2-Jul-25	B10	14: 22	Sunny	0.0%	0	20.5	0%LEL	33.3℃ 33.3℃	
2-Jul-25	B1a	14: 50	Sunny	0.0%	0	20.5	0%LEL	33,3℃	
2-Jul-25	B1c	15 : 8	Sunny	0.0%	0	20.5	0%LEL	33.3°C	
2-Jul-25	A1	15 : 24	Sunny	0.0%	0	20.5	0%LEL	33.3°C	
3-Jul-25	C1	8: 41	Sunny	0.0%	0	20.5	0%LEL	33.3°C	
3-Jul-25	B2	9: 9	Sunny	0.0%	0	20.2	0%LEL	30.3°C	
3-Jul-25	B9	9: 16	Sunny	0.0%	0	20.2	0%LEL	30.3°C	
3-Jul-25	B10	9: 32	Sunny	0.0%	0	20.2	0%LEL	30.3°C	
3-Jul-25	B1a	9: 54	Sunny	0.0%	0	20.2	0%LEL	30.3℃	-
3-Jul-25	B1c	10: 13	Sunny	0.0%	0	20.2	0%LEL	30.3°C	
3-Jul-25	A1	10: 31	Sunny	0.0%	0	20.2	0%LEL	30.3°C	
3-Jul-25	C1	13 : 20	Sunny	0.0%	0	20.2	0%LEL	33.6°C	
3-Jul-25	B2	13 : 39	Sunny	0.0%	0	20.2	0%LEL	33.6°C	
3-Jul-25	B9	13 : 58	Sunny	0.0%	0	20.2	0%LEL	33.6℃	
3-Jul-25	B10	15 : 12	Sunny	0.0%	0	20.2	0%LEL	33.6°C	
3-Jul-25	B1a	15 : 32	Sunny	0.0%	0	20.2	0%LEL	33.6°C	
3-Jul-25	B1c	15 : 44	Sunny	0.0%	Ö	20.2	0%LEL	33.6°C	
3-Jul-25	A1	15 : 59	Sunny	0.0%	0	20.2	0%LEL	33.6°C	
4-Jul-25	C1	8: 44	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	B2	9: 16	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	В9	9: 33	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	B10	9: 48	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	B1a	10: 15	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	B1c	10: 28	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	A1	10 : 51	Sunny	0.0%	0	20.2	0%LEL	30.8°C	
4-Jul-25	C1	13: 48	Sunny	0.0%	0	20.2	0%LEL	34.5℃	
4-Jul-25	B2	14: 15	Sunny	0.0%	0	20.2	0%LEL	34.5°C	
4-Jul-25	B9	14: 34	Sunny	0.0%	0	20.2	0%LEL	34.5°C	
4-Jul-25	B10	14 : 54	Sunny	0.0%	0	20,2	0%LEL	34.5°C	
4-Jul-25	B1a	15 : 20	Sunny	0.0%	0	20.2	0%LEL	34.5°C	
4-Jul-25	B1c	15 : 33	Sunny	0.0%	0	20.2	0%LEL	34.5℃	
4-Jul-25	A1	15 : 54	Sunny	0.0%	0	20.2	0%LEL	34.5°C	
5-Jul-25	C1	8 : 39	Sunny	0.0%	0	20.3	0%LEL	30.6°C	
5-Jul-25	B2	9: 11	Sunny	0.0%	0	20.3	0%LEL	30.6℃	
5-Jul-25	B9	9: 33	Sunny	0.0%	0	20.3	0%LEL	30.6°C	
5-Jul-25	B10	9; 46	Sunny	0.0%	0	20.3	0%LEL	30.6℃	
5-Jul-25	B1a	10 : 12	Sunny	0.0%	0	20.3	0%LEL	30.6℃	
5-Jul-25	B1c	10 : 29	Sunny	0.0%	0	20.3	0%LEL	30.6°C	
5-Jul-25	A1	10 : 44	Sunny	0.0%	0	20.3	0%LEL	30.6°C	
5-Jul-25	C1	13 : 44	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
5-Jul-25	B2	14: 7	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
5-Jul-25 5-Jul-25	B9	14 : 28	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
5-Jul-25 5-Jul-25	B10	14 : 52	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
5-Jul-25 5-Jul-25	B1a B1a	15 : 16	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
5-Jul-25 5-Jul-25	B1c A1	15 : 36	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
5-Jul-25 6-Jul-25	C1	15 : 50	Sunny	0.0%	0	20.3	0%LEL	34.8°C	
6-Jul-25	B2	8: 41	Sunny	0.0%	0	20,4	0%LEL	30,3°C	
6-Jul-25	B2 B9	9 ; 11 9 ; 31	Sunny	0.0%	0	20.4	0%LEL	30.3°C	
6-Jul-25	B10	9; 31 9; 54	Sunny	0.0%		20.4	0%LEL	30.3°C	
6-Jul-25			Sunny		0	20.4	0%LEL	30.3°C	
6-Jul-25 6-Jul-25	B1a B1c	10: 15 10: 32	Sunny	0.0%	0	20.4	0%LEL	30.3℃	
6-Jul-25	A1		Sunny	0.0%		20.4	0%LEL	30.3°C	
6-Jul-25	C1	10: 45	Sunny	0.0%	0	20.4	0%LEL	30,3°C	
6-Jul-25	B2	13: 32	Sunny	0.0%	0	20.4	0%LEL	33.5°C	
6-Jul-25	B2 B9	13 : 50	Sunny	0.0%	0	20.4	0%LEL	33.5℃	
6-Jul-25 6-Jul-25	B9 B10	15: 16	Sunny	0.0%	0	20.4	0%LEL	33.5°C	
6-Jul-25	B10 B1a	15: 33	Sunny	0.0%	0	20.4	0%LEL	33.5℃	
6-Jul-25		15 : 58	Sunny	0.0%	0	20.4	0%LEL	33.5°C	
6-Jul-25	B1c	16: 13	Sunny	0.0%	0	20.4	0%LEL	33.5°C	
U*JUEZJ	A1	16: 34	Sunny	0.0%	0	20.4	0%LEL	33.5°C	(1)



Contract No.: EP/SP/186/21

Name of construction site: West New Territories Landfill Extension

Month of measurement :

1-Aug-24	
20-Mar-25	

7 × = 1						Monitoring of Excaval	ion		
Date of measurement	Sample location	Sampling time	Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (*C)	Remark
7-Jul-25	C1	8: 33	Sunny	0.0%	0	20.4	0%LEL	31,2°C	
7-Jul-25	B2	8 : 51	Sunny	0.0%	0	20.4	0%LEL	31.2°C	
7-Jul-25	B9	9: 16	Sunny	0.0%	0	20.4	0%LEL	31.2°C	
7-Jul-25	B10	9: 37	Sunny	0.0%	0	20.4	0%LEL	31.2°C	
7-Jul-25	B1a	10:8	Sunny	0.0%	0	20.4	0%LEL	31.2°C	
7-Jul-25 7-Jul-25	B1c	10: 21	Sunny	0.0%	0	20.4	0%LEL	31.2℃	
7-Jul-25	A1 C1	10:41	Sunny	0.0%	0	20.4	0%LEL	31.2°C	
7-Jul-25	B2	13 : 54 14 : 17	Sunny	0.0%	0	20.4	0%LEL	34.3°C	
7-Jul-25	B9	14: 17	Sunny	0.0%	0	20.4	0%LEL	34.3°C 34.3°C	
7-Jul-25	B10	14 : 59	Sunny	0.0%	0	20.4	0%LEL	34.3°C	
7-Jul-25	B1a	15: 16	Sunny	0.0%	0	20.4	0%LEL	34.3°C	
7-Jul-25	B1c	15: 32	Sunny	0.0%	0	20.4	0%LEL	34.3°C	
7-Jul-25	A1	15: 44	Sunny	0.0%	0	20.4	0%LEL	34.3°C	
8-Jul-25	C1	8: 35	Sunny	0.0%	0	20.2	0%LEL	30.9°C	
8-Jul-25	B2	9: 11	Sunny	0.0%	0	20.2	0%LEL	30.9℃	
8-Jul-25	B9	9: 30	Sunny	0.0%	0	20.2	0%LEL	30.9℃	
8-Jul-25	B10	9: 54	Sunny	0.0%	0	20.2	0%LEL	30.9°C	
8-Jul-25	B1a	10: 18	Sunny	0.0%	0	20.2	0%LEL	30.9°C	
8-Jul-25	B1c	10: 35	Sunny	0.0%	0	20.2	0%LEL	30.9°C	
8-Jul-25	A1	10 : 46	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
8-Jul-25	C1	13: 29	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
8-Jul-25	B2	13 : 50	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
8-Jul-25	B9	14: 17	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
8-Jul-25	B10	14 ; 41	Sunny	0.0%	0	20.2	0%LEL	33,3°C	
8-Jul-25	B1a	15 : 11	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
8-Jul-25	B1c	15 : 32	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
8-Jul-25	A1	15 : 46	Sunny	0.0%	0	20.2	0%LEL	33.3°C	
9-Jul-25 9-Jul-25	C1	8 : 41	Rainy	0.0%	0	20.2	0%LEL	30.7°C	
9-Jul-25 9-Jul-25	B2	8: 59	Rainy	0.0%	0	20.2	0%LEL	30.7°C	
9-Jul-25	B9 B10	9: 32	Rainy	0.0%	0	20.2	0%LEL	30.7°C	
9-Jul-25	B1a	9 : 49 10 : 16	Rainy Rainy	0.0%	0	20.2	0%LEL	30.7°C	
9-Jul-25	B1c	10 : 16	Rainy	0.0%	0	20.2	0%LEL 0%LEL	30.7°C 30.7°C	
9-Jul-25	A1	10 : 28	Rainy	0.0%	0	20.2	0%LEL	30.7℃	
9-Jul-25	C1	13: 36	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
9-Jul-25	B2	13: 50	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
9-Jul-25	B9	15 : 18	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
9-Jul-25	B10	15 : 32	Rainy	0.0%	0	20.2	0%LEL	33.6°C	7-7
9-Jul-25	B1a	16 : 8	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
9-Jul-25	B1c	16 : 26	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
9-Jul-25	A1	16: 39	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
10-Jul-25	C1	8: 44	Rainy	0.0%	0	20.5	0%LEL	26.3°C	
10-Jul-25	B2	9: 16	Rainy	0.0%	0	20.5	0%LEL	26.3°C	
10-Jul-25	B9	9: 30	Rainy	0.0%	0	20.5	0%LEL	26.3°C	
10-Jul-25	B10	9 ; 53	Rainy	0.0%	0	20.5	0%LEL	26.3°C	
10-Jul-25	B1a	10 : 25	Rainy	0.0%	0	20.5	0%LEL	26.3°C	
10-Jul-25	B1c	10: 38	Rainy	0.0%	0	20.5	0%LEL	26.3℃	
10-Jul-25	A1	10 ; 50	Rainy	0.0%	0	20.5	0%LEL	26.3℃	
10-Jul-25	C1	13 : 27	Rainy	0.0%	0	20.5	0%LEL	29°C	
10-Jul-25	B2	13 : 51	Rainy	0.0%	0	20.5	0%LEL	29°C	
10-Jul-25 10-Jul-25	B9	15 : 18	Rainy	0.0%	0	20.5	0%LEL	29°C	
10-Jul-25	B10 B1a	15 : 42	Rainy	0.0%	0	20.5	0%LEL	29°C	
10-Jul-25	B1c	16: 12	Rainy	0.0%	0	20.5	0%LEL	29°C	2
10-Jul-25	A1	16 : 22 16 : 39	Rainy Rainy	0.0%	0	20.5	0%LEL 0%LEL	29°C	
11-Jul-25	C1	8: 44	Sunny	0.0%	0	20.5	0%LEL	29°C 27.9°C	
11-Jul-25	B2	9: 20	Sunny	0.0%	0	20.5	0%LEL	27.9℃ 27.9℃	
11-Jul-25	89	9: 39	Sunny	0.0%	0	20.5	0%LEL	27.9°C	
11-Jul-25	B10	9: 58	Sunny	0.0%	0	20.5	0%LEL	27.9°C	
11-Jul-25	B1a	10 : 21	Sunny	0.0%	0	20.5	0%LEL	27.9°C	
11-Jul-25	B1c	10: 39	Sunny	0.0%	0	20.5	0%LEL	27.9°C	
11-Jul-25	A1	10 : 54	Sunny	0.0%	0	20.5	0%LEL	27.9°C	
11-Jul-25	C1	13 : 39	Sunny	0.0%	0	20.5	0%LEL	29.9°C	
11-Jul-25	B2	14: 19	Sunny	0.0%	0	20.5	0%LEL	29.9°C	
11-Jul-25	B9	14: 39	Sunny	0.0%	0	20,5	0%LEL	29.9°C	
11-Jul-25	B10	15 : 15	Sunny	0.0%	0	20.5	0%LEL	29.9℃	
11-Jul-25	B1a	15 : 39	Sunny	0.0%	0	20.5	0%LEL	29.9°C	
11-Jul-25	B1c	16: 11	Sunny	0.0%	0	20.5	0%LEL	29.9°C	
11-Jul-25	A1	16: 36	Sunny	0.0%	0	20.5	0%LEL	29.9°C	
12-Jul-25	C1	8: 44	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25	B2	9: 16	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25 12-Jul-25	B9	9: 36	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25 12-Jul-25	B10	9 ; 51	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25 12-Jul-25	B1a	10: 18	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25 12-Jul-25	B1c A1	10: 33	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25	C1	10: 59	Rainy	0.0%	0	20.3	0%LEL	28.7°C	
12-Jul-25	B2	13 ; 40 14 : 16	Rainy Rainy	0.0%	0	20.3	0%LEL	31.3°C	
12-Jul-25	B9 B9	14: 16	Rainy	0.0%	0	20.3	0%LEL	31.3°C 31.3°C	
12-Jul-25	B10	15 : 16	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
12-Jul-25	B1a	15: 49	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
12-Jul-25	B1c	16: 14	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
12-Jul-25	A1	16 : 44	Rainy	0.0%	0	20.3	0%LEL		0
- Acres (ABS)						20.0		- 1 -1	2



Contract No.: EP/SP/186/21

Name of construction site: West New Territories Landfill Extension

Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	1-Aug-24
SKY3000 Series (LEL)	20-Mar-25

						Monitoring of Excava	tion		
Date of measurement	Sample location	Sampling time	Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (*C)	Remark
13-Jul-25	C1	8: 41	Sunny	0.0%	0	20.4	0%LEL	30.1°C	
13-Jul-25	B2	9: 12	Sunny	0.0%	0	20.4	0%LEL	30.1°C	
13-Jul-25	B9	9: 33	Sunny	0.0%	0	20.4	0%LEL	30.1℃	
13-Jul-25	B10	9 ; 51	Sunny	0.0%	0	20.4	0%LEL	30.1°C	
13-Jul-25	B1a	10: 18	Sunny	0.0%	0	20.4	0%LEL	30.1°C	
13-Jul-25	B1c	10: 32	Sunny	0.0%	0	20.4	0%LEL	30.1°C	
13-Jul-25	A1	10 : 49	Sunny	0.0%	0	20.4	0%LEL	30.1°C	
13-Jul-25	C1	13: 39	Sunny	0.0%	0	20.4	0%LEL	33.3°C	
13-Jul-25	B2	14: 14	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
13-Jul-25 13-Jul-25	89	14: 39	Sunny	0.0%	0	20.4	0%LEL	33.3°C	
13-Jui-25	B10	15: 11	Sunny	0.0%	0	20.4	0%LEL	33.3°C	
13-Jul-25	B1a B1c	15 : 41	Sunny	0.0%	0	20.4	0%LEL	33.3°C	
13-Jul-25	A1	15 : 58	Sunny	0.0%	0	20.4	0%LEL	33.3°C	
14-Jul-25	C1	16 : 16 8 : 33	Sunny Cloudy	0.0%	0	20.4	0%LEL	33.3°C	
14-Jul-25	B2	8: 51	Cloudy	0.0%	0	20.5	0%LEL 0%LEL	30.2°C	
14-Jul-25	89	9: 16	Cloudy	0.0%	0	20.5	0%LEL	30.2℃ 30.2℃	
14-Jul-25	B10	9: 29	Cloudy	0.0%	0	20.5	0%LEL	30.2°C	
14-Jul-25	B1a	9: 44	Cloudy	0.0%	0	20.5	0%LEL	30.2°C	
14-Jul-25	B1c	10: 7	Cloudy	0.0%	0	20.5	0%LEL	30.2°C	+
14-Jul-25	A1	10: 18	Cloudy	0.0%	0	20.5	0%LEL	33.2°C	
14-Jul-25	C1	13 : 22	Cloudy	0.0%	0	20.5	0%LEL	33.2℃	-
14-Jul-25	B2	13 : 51	Cloudy	0.0%	0	20.5	0%LEL	33.2°C	
14-Jul-25	89	14: 15	Cloudy	0.0%	0	20.5	0%LEL	33.2°C	
14-Jul-25	B10	14 : 45	Cloudy	0.0%	0	20.5	0%LEL	33.2℃	
14-Jul-25	B1a	16 : 9	Cloudy	0.0%	0	20.5	0%LEL	33.2°C	
14-Jul-25	B1c	16 : 26	Cloudy	0.0%	0	20.5	0%LEL	33.2°C	1
14-Jul-25	A1	16 : 44	Cloudy	0.0%	0	20.5	0%LEL	33.2°C	
15-Jul-25	C1	8 : 54	Sunny	0.0%	0	20.5	0%LEL	30.3°C	
15-Jul-25	B2	9: 18	Sunny	0.0%	0	20.5	0%LEL	30.3°C	
15-Jul-25	B9	9: 39	Sunny	0.0%	0	20.5	0%LEL	30.3℃	
15-Jul-25	B10	9: 68	Sunny	0.0%	0	20.5	0%LEL	30.3°C	
15-Jul-25	B1a	10 : 24	Sunny	0.0%	0	20.5	0%LEL	30.3°C	
15-Jul-25	B1c	10: 39	Sunny	0.0%	0	20.5	0%LEL	30.3°C	
15-Jul-25	A1	10: 54	Sunny	0.0%	0	20.5	0%LEL	30.3°C	
15-Jul-25	C1	13: 39	Sunny	0.0%	0	20.5	0%LEL	32.7°C	
15-Jul-25	B2	15: 8	Sunny	0.0%	0	20.5	0%LEL	32.7°C	
15-Jul-25	B9	15: 24	Sunny	0.0%	0	20.5	0%LEL	32.7°C	
15-Jul-25	B10	15 : 54	Sunny	0.0%	0	20.5	0%LEL	32.7°C	
15-Jul-25	B1a	16 ; 26	Sunny	0.0%	0	20.5	0%LEL	32.7°C	
15-Jul-25	B1c	16 : 46	Sunny	0.0%	0	20,5	0%LEL	32.7°C	
15-Jul-25	A1	16 : 55	Sunny	0.0%	0	20.5	0%LEL	32.7°C	557
16-Jul-25	C1	8: 26	Sunny	0.0%	0	20.4	0%LEL	31.1°C	
16-Jul-25	B2	8: 58	Sunny	0.0%	0	20.4	0%LEL	31.1°C	
16-Jul-25	B9	9: 15	Sunny	0.0%	0	20.4	0%LEL	31.1°C	
16-Jul-25	B10	9: 33	Sunny	0.0%	0	20.4	0%LEL	31.1°C	
16-Jul-25 16-Jul-25	B1a	10: 9	Sunny	0.0%	0	20.4	0%LEL	31.1°C	
16-Jul-25	B1c A1	10 : 28 10 : 44	Sunny	0.0%	0	20.4	0%LEL	31.1°C	
16-Jul-25	C1	13: 44	Sunny	0.0%	0	20.4	0%LEL 0%LEL	31.1°C	
16-Jul-25	B2	14: 16	Sunny	0.0%	0	20.4	0%LEL	34°C 34°C	
16-Jul-25	B9	14 : 38	Sunny	0.0%	0	20.4	0%LEL	34°C	
16-Jul-25	B10	15 : 6	Sunny	0.0%	0	20.4	0%LEL	34°C	
16-Jul-25	B1a	15: 38	Sunny	0.0%	0	20.4	0%LEL	34°C	
16-Jul-25	B1c	15 : 58	Sunny	0.0%	0	20.4	0%LEL	34°C	-
16-Jul-25	A1	16: 16	Sunny	0.0%	0	20.4	0%LEL	34°C	
17-Jul-25	C1	8 : 41	Sunny	0.0%	0	20.2	0%LEL	31.3°C	
17-Jul-25	B2	9: 17	Sunny	0.0%	0	20.2	0%LEL	31.3°C	
17-Jul-25	B9	9 : 45	Sunny	0.0%	0	20.2	0%LEL	31.3°C	
17-Jul-25	B10	10: 9	Sunny	0.0%	0	20.2	0%LEL	31.3℃	
17-Jul-25	B1a	10 : 39	Sunny	0.0%	0	20.2	0%LEL	31.3°C	
17-Jul-25	B1c	11 : 15	Sunny	0.0%	0	20.2	0%LEL	31.3°C	
17-Jul-25	A1	11: 26	Sunny	0.0%	0	20.2	0%LEL	31.3°C	
17-Jul-25	C1	13 : 33	Sunny	0.0%	0	20.2	0%LEL	34.2°C	
17-Jul-25	B2	14: 7	Sunny	0.0%	0	20.2	0%LEL	34.2°C	
17-Jul-25	B9	14: 27	Sunny	0.0%	0	20.2	0%LEL	34.2℃	
17-Jul-25	B10	14: 53	Sunny	0.0%	0	20.2	0%LEL	34.2°C	
17-Jul-25 17-Jul-25	B1a	15 ; 29	Sunny	0.0%	0	20.2	0%LEL	34.2°C	
17-Jul-25 17-Jul-25	B1c A1	15 : 46	Sunny	0.0%	0	20.2	0%LEL	34.2°C	
18-Jul-25	C1	16 : 14	Sunny	0.0%	0	20.2	0%LEL	34.2°C	
18-Jul-25	B2	8 : 33 8 : 54	Rainy Rainy	0.0%	0	20.3	0%LEL	28.6°C	
18-Jul-25	B9	9: 16	Rainy	0.0%	0	20.3 20.3	0%LEL 0%LEL	28.6°C	
18-Jul-25	B10	9: 16	Rainy	0.0%	0	20.3	0%LEL	28.6°C	
18-Jul-25	B1a	10: 10	Rainy	0.0%	0	20.3	0%LEL	28.6°C	
18-Jul-25	B1c	10: 10	Rainy	0.0%	0	20.3	0%LEL	28.6°C	
18-Jul-25	A1	10 : 51	Rainy	0.0%	0	20.3	0%LEL	28.6℃	
18-Jul-25	C1	13: 29	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
18-Jul-25	B2	13 : 54	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
18-Jul-25	B9	15: 30	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
18-Jul-25	B10	15: 45	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
18-Jul-25	B1a	16 : 16	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
18-Jul-25	B1c	16: 28	Rainy	0.0%	0	20.3	0%LEL	31.3°C	
18-Jul-25	A1	16 : 35	Rainy	0.0%	0	20.3	0%LEL	31.3°C	<u></u>

·	w.		
		×	



Contract No.: EP/SP/186/21

Name of construction site: West New Territories Landfill Extension Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	1-Aug-24
SKY3000 Series (LEL)	20-Mar-25

	1		T			Monitoring of Excava	tion		
Date of measurement	Sample location	Sampling time	Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (*C)	Remark
19-Jul-25	C1	8: 44	Cloudy	0.0%	0	20.2	0%LEL	29.5°C	
19-Jul-25	B2	9: 18	Cloudy	0.0%	0	20.2	0%LEL	29.5°C	
19-Jul-25	B9	9: 35	Cloudy	0.0%	0	20.2	0%LEL	29.5°C	
19-Jul-25	B10	9; 50	Cloudy	0.0%	0	20.2	0%LEL	29.5°C	
19-Jul-25	B1a	10: 16	Cloudy	0.0%	0	20.2	0%LEL	29.5°C	
19-Jul-25	B1c	10: 30	Cloudy	0.0%	0	20.2	0%LEL	29.5°C	
19-Jul-25	A1	10: 44	Cloudy	0.0%	0	20.2	0%LEL	29.5℃	
19-Jul-25	C1	13: 36	Cloudy	0.0%	0	20.2	0%LEL	33.5°C	
19-Jul-25	B2	14 : 10	Cloudy	0.0%	0	20.2	0%LEL	33.5°C	
19-Jul-25	B9	14: 32	Cloudy	0.0%	0	20.2	0%LEL	33.5℃	
19-Jul-25	B10	14: 50	Cloudy	0.0%	0	20.2	0%LEL	33.5°C	
19-Jul-25 19-Jul-25	B1a	15 : 14	Cloudy	0.0%	0	20.2	0%LEL	33.5°C	
19-Jul-25	B1c	15 : 36	Cloudy	0.0%	0	20.2	0%LEL	33.5°C	
20-Jul-25	A1 C1	15 : 54	Cloudy	0.0%	0	20.2	0%LEL	33.5°C	
20-Jul-25	B2	8: 33	Rainy	0.0%	0	20.3	0%LEL	27°C	
20-Jul-25	B9	8 : 51 9 : 16	Rainy	0.0%	0	20.3	0%LEL	27°C	
20-Jul-25	B10	9: 36	Rainy Rainy	0.0%	0	20.3	0%LEL	27°C	
20-Jul-25	B1a	10: 20	Rainy	0.0%	0	20.3	0%LEL	27°C	
20-Jul-25	B1c	10 : 38	Rainy	0.0%	0	20.3	0%LEL	27°C	
20-Jul-25	A1	10: 49	Rainy	0.0%	0				
20-Jul-25	C1	13 : 50	Rainy	0.0%	0	20.3	0%LEL	28°C 28°C	+
20-Jul-25	B2	14: 32	Rainy	0.0%	0	20.3	0%LEL	28°C	1
20-Jul-25	B9	14: 51	Rainy	0.0%	0	20.3	0%LEL	28°C	+
20-Jul-25	B10	15: 16	Rainy	0.0%	0	20.3	0%LEL	28°C	
20-Jul-25	B1a	15: 44	Rainy	0.0%	0	20.3	0%LEL	28°C	
20-Jul-25	B1c	16: 14	Rainy	0.0%	0	20.3	0%LEL	28°C	
20-Jul-25	A1	16 : 26	Rainy	0.0%	0	20.3	0%LEL	28°C	
21-Jul-25	C1	8: 30	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	B2	8: 58	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	B9	9: 18	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	B10	9: 50	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	B1a	10: 24	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	B1c	10: 50	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	A1	11: 11	Rainy	0.0%	0	20.2	0%LEL	27.1°C	
21-Jul-25	C1	13: 44	Rainy	0.0%	0	20.2	0%LEL	27.9℃	
21-Jul-25	B2	14: 10	Rainy	0.0%	0	20.2	0%LEL	27.9°C	
21-Jul-25	B9	14: 32	Rainy	0.0%	0	20.2	0%LEL	27.9°C	
21-Jul-25	B10	14: 51	Rainy	0.0%	0	20.2	0%LEL	27.9°C	
21-Jul-25	B1a	15: 19	Rainy	0.0%	0	20.2	0%LEL	27.9°C	=======================================
21-Jul-25	B1c	15: 39	Rainy	0.0%	0	20.2	0%LEL	27.9°C	
21-Jul-25	A1	15 : 59	Rainy	0.0%	0	20.2	0%LEL	27.9°C	
22-Jul-25	C1	8: 34	Rainy	0.0%	0	20,2	0%LEL	28°C	
22-Jul-25	B2	8: 54	Rainy	0.0%	0	20.2	0%LEL	28°C	
22-Jul-25	B9	9: 16	Rainy	0.0%	0	20.2	0%LEL	28°C	
22-Jul-25	B10	9: 32	Rainy	0.0%	0	20.2	0%LEL	28°C	
22-Jul-25	B1a	10: 10	Rainy	0.0%	0	20.2	0%LEL	28°C	
22-Jul-25 22-Jul-25	B1c	10: 24	Rainy	0.0%	0	20.2	0%LEL	28°C	
22-Jul-25	A1 C1	10 : 41	Rainy	0.0%	0	20.2	0%LEL	28℃	
22-Jul-25	B2	13: 30 13: 55	Rainy	0.0%	0	20.2	0%LEL	30.5℃	
22-Jul-25	B9	14: 16	Rainy Rainy	0.0%	0	20.2	0%LEL	30.5°C	
22-Jul-25	B10	14: 38	Rainy	0.0%	0	20.2	0%LEL	30.5°C	
22-Jul-25	B1a	15: 12	Rainy	0.0%	0	20.2	0%LEL 0%LEL	30.5℃ 30.5℃	
22-Jul-25	B1c	15 : 29	Rainy	0.0%	0	20.2	0%LEL	30.5°C	
22-Jul-25	A1	15 : 44	Rainy	0.0%	0	20.2	0%LEL	30.5°C	
23-Jul-25	C1	8: 35	Sunny	0.0%	0	20.3	0%LEL	29℃	
23-Jul-25	B2	8 : 58	Sunny	0.0%	0	20.3	0%LEL	29°C	
23-Jul-25	B9	9: 16	Sunny	0.0%	0	20.3	0%LEL	29°C	
23-Jul-25	B10	9: 32	Sunny	0.0%	0	20.3	0%LEL	29°C	
23-Jul-25	B1a	10: 15	Sunny	0.0%	0	20.3	0%LEL	29°C	
23-Jul-25	B1c	10: 28	Sunny	0.0%	0	20.3	0%LEL	29°C	
23-Jul-25	A1	10: 39	Sunny	0.0%	0	20.3	0%LEL	29°C	
23-Jul-25	C1	13 : 33	Sunny	0.0%	0	20.3	0%LEL	33.3°C	
23-Jul-25	B2	13: 54	Sunny	0.0%	0	20.3	0%LEL	33.3°C	
23-Jul-25	B9	14: 16	Sunny	0.0%	0	20.3	0%LEL	33.3℃	
23-Jul-25	B10	14: 39	Sunny	0.0%	0	20.3	0%LEL	33.3℃	
23-Jul-25	B1a	15: 8	Sunny	0.0%	0	20.3	0%LEL	33.3°C	
23-Jul-25	B1c B1c	15: 19	Sunny	0.0%	0	20.3	0%LEL	33.3°C	
23-Jul-25	A1	15: 36	Sunny	0.0%	0	20.3	0%LEL	33.3°C	
24-Jul-25	C1	8: 40	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25 24-Jul-25	B2	9: 16	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25 24-Jul-25	B9 B10	9 ; 29	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25	B10 B1a	9: 44	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25	B1a B1c	10: 16	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25	A1	10: 30 10: 39	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25	C1	10: 39	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
24-Jul-25	B2	13 : 24	Cloudy	0.0%	0	20.5	0%LEL 0%LEL	32°C	
24-Jul-25	B9	15: 16	Cloudy	0.0%	0	20.5		32°C	
24-Jul-25	B10	15: 16	Cloudy	0.0%	0	20.5	0%LEL	32°C	
24-Jul-25	B1a	16: 16	Cloudy	0.0%	0	20.5 20.5	0%LEL 0%LEL	32°C	
24-Jul-25	B1c	16 : 28	Cloudy	0.0%	0	20.5	0%LEL	32°C	
24-Jul-25	A1	16: 39	Cloudy	0.0%	0	20.5	0%LEL	32°C	
1 1000 A 100 TO TO TO		10. 00	oloudy	0.070	-	20.3	OVELER	JEL	

		i.ž			



Contract No.: EP/SP/186/21
Name of construction site: West New Territories Landfill Extension

 Sampling equipment used:
 Date calibrated

 GEM5000
 1-Aug-24

 SKY3000 Series (LEL)
 20-Mar-25

	Month of measurement :			-			-		
Date of measurement	Sample location	Sampling time	Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Monitoring of Excava Oxygen (0.1%)	Flammable gas (LEL)	Temp (°C)	Remark
25-Jul-25	C1	8: 33	Rainy	0.0%	0	20.2	0%LEL	29.2°C	
25-Jul-25	B2	8 : 51	Rainy	0.0%	0	20.2	0%LEL	29.2°C	
25-Jul-25	B9	9: 15	Rainy	0.0%	0	20.2	0%LEL	29.2°C	
25-Jul-25 25-Jul-25	B10	9: 39	Rainy	0.0%	0	20.2	0%LEL	29.2°C	
25-Jul-25	B1a B1c	10 : 7 10 : 16	Rainy	0.0%	0	20.2	0%LEL	29.2°C	
25-Jul-25	A1	10 : 34	Rainy Rainy	0.0%	0	20.2	0%LEL	29.2°C	
25-Jul-25	C1	13 : 29	Rainy	0.0%	0	20.2	0%LEL	29.2℃	
25-Jul-25	B2	14: 16	Rainy	0.0%	0	20.2	0%LEL	33.6°C 33.6°C	
25-Jul-25	B9	14: 33	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
25-Jul-25	B10	14 : 51	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
25-Jul-25	B1a	15: 17	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
25-Jul-25	B1c	15 : 35	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
25-Jul-25 26-Jul-25	A1	15 : 46	Rainy	0.0%	0	20.2	0%LEL	33.6°C	
26-Jul-25	C1 B2	8 : 36 9 : 19	Sunny	0.0%	0	20.4	0%LEL	30.2°C	
26-Jul-25	89	9: 34	Sunny	0.0%	0	20.4	0%LEL	30.2℃	
26-Jul-25	B10	9: 51	Sunny	0.0%	0	20.4	0%LEL	30.2℃	
26-Jul-25	B1a	10 : 24	Sunny	0.0%	0	20.4	0%LEL	30.2°C	
26-Jul-25	B1c	10 : 36	Sunny	0.0%	0	20.4	0%LEL	30.2℃	
26-Jul-25	A1	10 : 54	Sunny	0.0%	0	20.4	0%LEL	35.2°C	
26-Jul-25	C1	13 : 21	Sunny	0.0%	0	20.4	0%LEL	35.2℃	
26-Jul-25	B2	13: 43	Sunny	0.0%	0	20.4	0%LEL	35,2℃	
26-Jul-25	B9	15 : 14	Sunny	0.0%	0	20.4	0%LEL	35.2℃	
26-Jul-25 26-Jul-25	B10 B1a	15 : 28	Sunny	0.0%	0	20.4	0%LEL	35.2°C	
26-Jul-25	B1c	15 : 52	Sunny	0.0%	0	20.4	0%LEL	35.2°C	
26-Jul-25	A1	16 : 20 16 : 36	Sunny	0.0%	0	20.4	0%LEL	35.2°C	
27-Jul-25	C1	8: 33	Sunny	0.0%	0	20.4	0%LEL	35.2℃	
27-Jul-25	B2	9:4	Sunny	0.0%	0	20.2	0%LEL	30.4°C 30.4°C	
27-Jul-25	B9	9: 30	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
27-Jul-25	B10	10: 10	Sunny	0.0%	0	20.2	0%LEL	30.4°C	
27-Jul-25	B1a	10: 26	Sunny	0.0%	0	20.2	0%LEL	30.4°C	
27-Jul-25	B1c	10: 44	Sunny	0.0%	0	20.2	0%LEL	30.4°C	
27-Jul-25	A1	10 : 51	Sunny	0.0%	0	20.2	0%LEL	30.4°C	
27-Jul-25	C1	13: 32	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
27-Jul-25 27-Jul-25	B2	13 : 53	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
27-Jul-25	B9 B10	14: 10	Sunny	0.0%	0	20.2	0%LEL	33.1°C	
27-Jul-25	B1a	14 : 32 14 : 52	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
27-Jul-25	B1c	15 : 14	Sunny	0.0%	0	20.2	0%LEL	33.1°C	
27-Jul-25	A1	15 : 34	Sunny	0.0%	0	20.2	0%LEL 0%LEL	33.1°C	
28-Jul-25	C1	8 : 38	Sunny	0.0%	0	20.2	0%LEL	33.1°C	
28-Jul-25	B2	9: 12	Sunny	0.0%	0	20.2	0%LEL	30.1°C 30.1°C	
28-Jul-25	B9	9: 29	Sunny	0.0%	0	20.2	0%LEL	30.1°C	
28-Jul-25	B10	9: 46	Sunny	0.0%	0	20.2	0%LEL	30.1°C	
28-Jul-25	B1a	10: 12	Sunny	0.0%	0	20.2	0%LEL	30.1°C	
28-Jul-25 28-Jul-25	B1c	10 : 26	Sunny	0.0%	0	20.2	0%LEL	30,1°C	
28-Jul-25	A1 C1	10: 38	Sunny	0.0%	0	20.2	0%LEL	30.1°C	
28-Jul-25	B2	13 : 40 14 : 13	Sunny Sunny	0.0%	0	20.2	0%LEL	32.8°C	
28-Jul-25	B9	14 : 36	Sunny	0.0%	0	20.2	0%LEL 0%LEL	32.8℃	
28-Jul-25	B10	15 : 2	Sunny	0.0%	0	20.2	0%LEL	32.8°C 32.8°C	
28-Jul-25	B1a	15 : 29	Sunny	0.0%	0	20.2	0%LEL	32.8°C	
28-Jul-25	B1c	16: 10	Sunny	0.0%	0	20.2	0%LEL	32.8°C	
28-Jul-25	A1	16 : 24	Sunny	0.0%	0	20.2	0%LEL	32.8°C	
29-Jul-25	C1	8: 27	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25 29-Jul-25	B2	8 : 54	Rainy	0.0%	0	20.4	0%LEL	30.1℃	D.
29-Jul-25	B9 B10	9: 13	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25	B1a	9 : 22 10 : 11	Rainy Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25	B1c	10 : 34	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25	A1	10 : 50	Rainy	0.0%	0	20.4	0%LEL 0%LEL	30.1°C 30.1°C	
29-Jul-25	C1	13 : 30	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25	B2	13: 51	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25	B9	14: 20	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25	B10	14: 38	Rainy	0.0%	0	20.4	0%LEL	30.1℃	
29-Jul-25 29-Jul-25	B1a	15: 9	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
29-Jul-25 29-Jul-25	B1c A1	15: 29	Rainy	0.0%	0	20.4	0%LEL	30.1°C	
30-Jul-25	C1	15 : 51 8 : 42	Rainy Cloudy	0.0%	0	20.4	0%LEL	30.1°C	
30-Jul-25	B2	9: 19	Cloudy	0.0%	0	20.5 20.5	0%LEL	26.6°C	
30-Jul-25	B9	9: 36	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25	B10	9: 49	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25	B1a	10: 14	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25	B1c	10 : 32	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25	A1	10 : 45	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25	C1	13: 42	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25 30-Jul-25	B2	14: 16	Cloudy	0.0%	0	20,5	0%LEL	26.6°C	
30-Jul-25 30-Jul-25	B9 B10	14: 33 14: 54	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
30-Jul-25	B10 B1a	16: 17	Cloudy	0.0%	0	20.5 20.5	0%LEL	26.6°C	
30-Jul-25	B1c	16 : 17	Cloudy	0.0%	0	20.5	0%LEL 0%LEL	26.6°C	
30-Jul-25	A1	16 : 43	Cloudy	0.0%	0	20.5	0%LEL	26.6°C	
31-Jul-25	C1	8: 35	Cloudy	0.0%	o	20.5	0%LEL	26.6°C	
31-Jul-25	B2	8: 54	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	B9	9: 14	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	B10	9: 33	Cloudy	0.0%	0	20.5	0%LEL	29.4℃	
31-Jul-25	B1a	10 : 8	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	B1c	10: 19	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	A1	10: 36	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25 31-Jul-25	C1 B2	13: 30 14: 10	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	B9	14: 10	Cloudy	0.0%	0	20.5 20.5	0%LEL 0%LEL	29.4°C 29.4°C	
31-Jul-25	B10	14: 59	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	B1a	15 : 20	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	B1c	15: 34	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	
31-Jul-25	A1	15: 47	Cloudy	0.0%	0	20.5	0%LEL	29.4°C	0
									7 1-5





Appendix J

Graphical Plots for Monitoring Result





Air Quality - 1-hour TSP

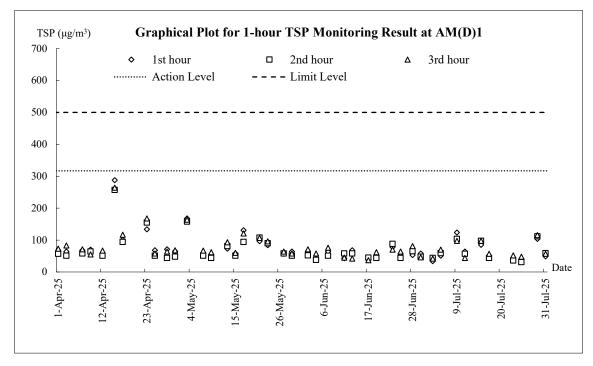

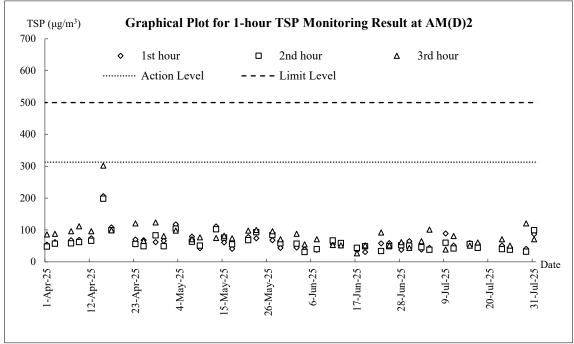





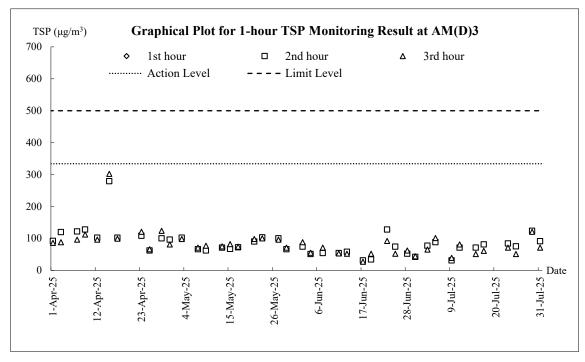

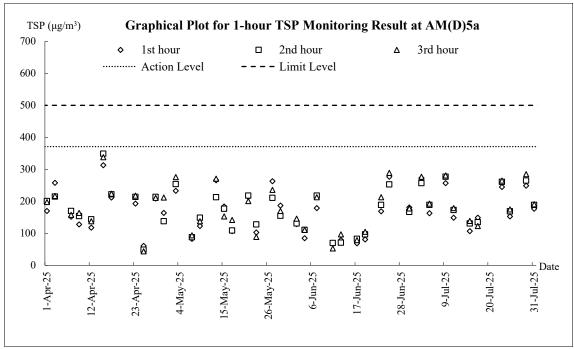




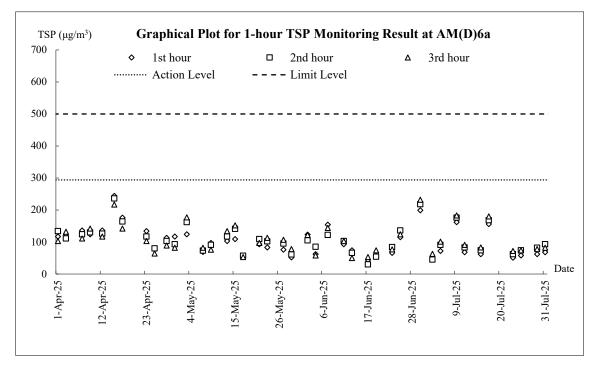


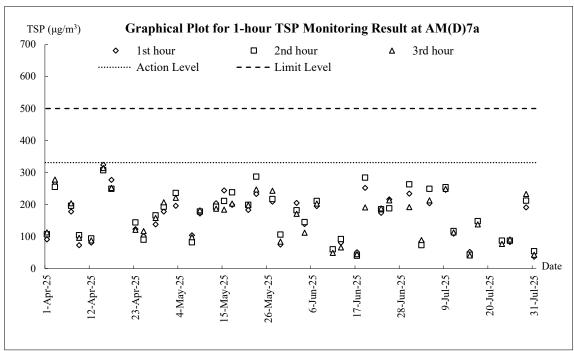





Air Quality - 24-hour TSP

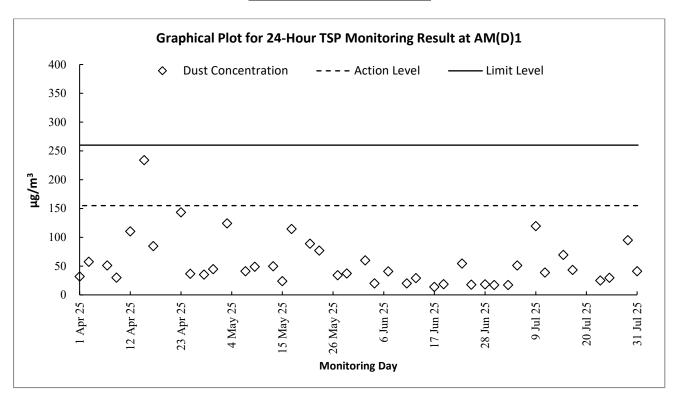

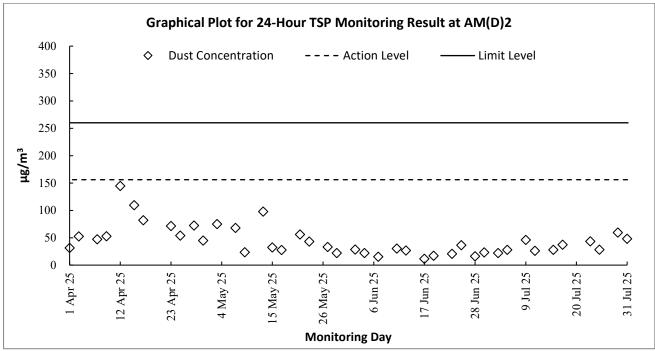





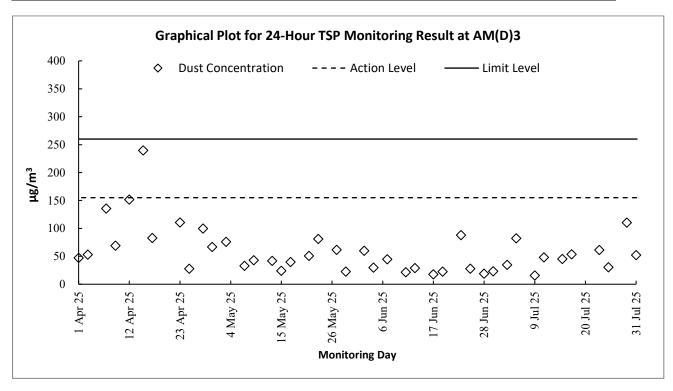

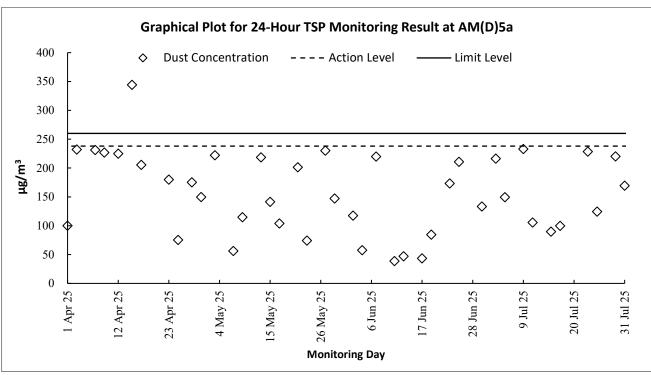




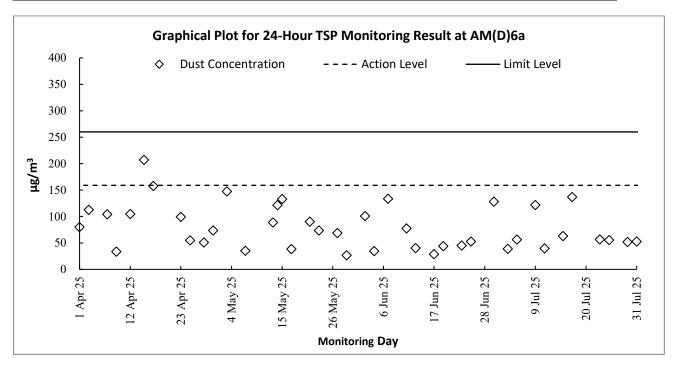

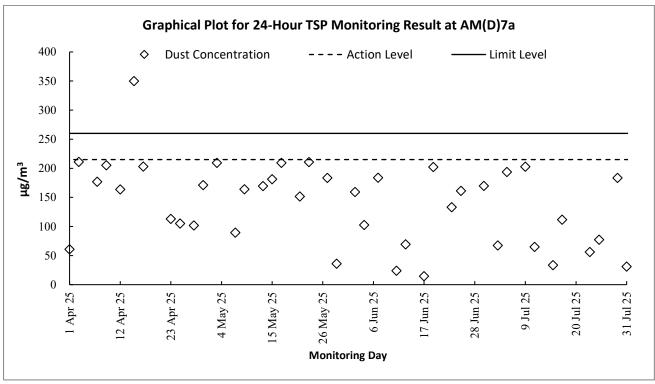




Construction Noise

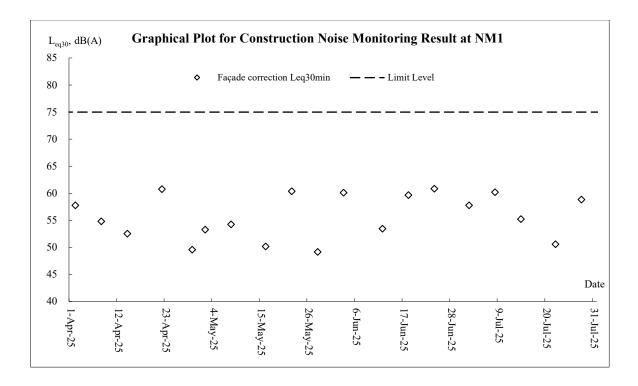





Surface Water

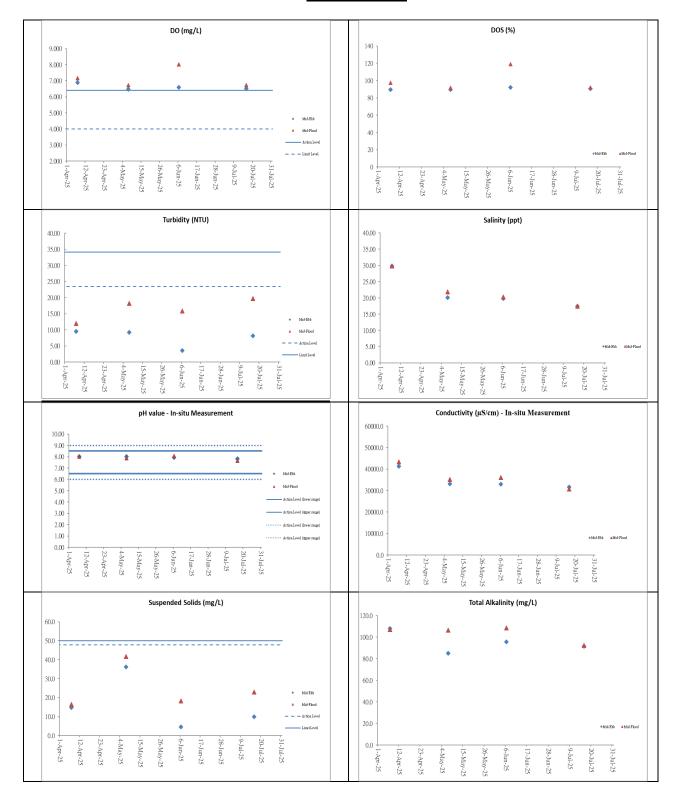




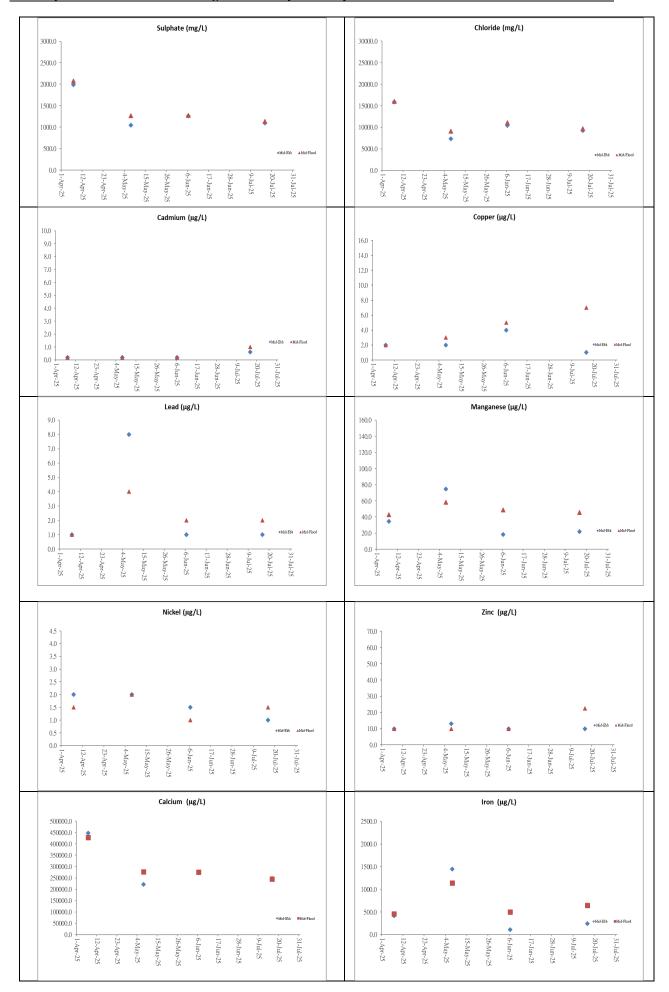



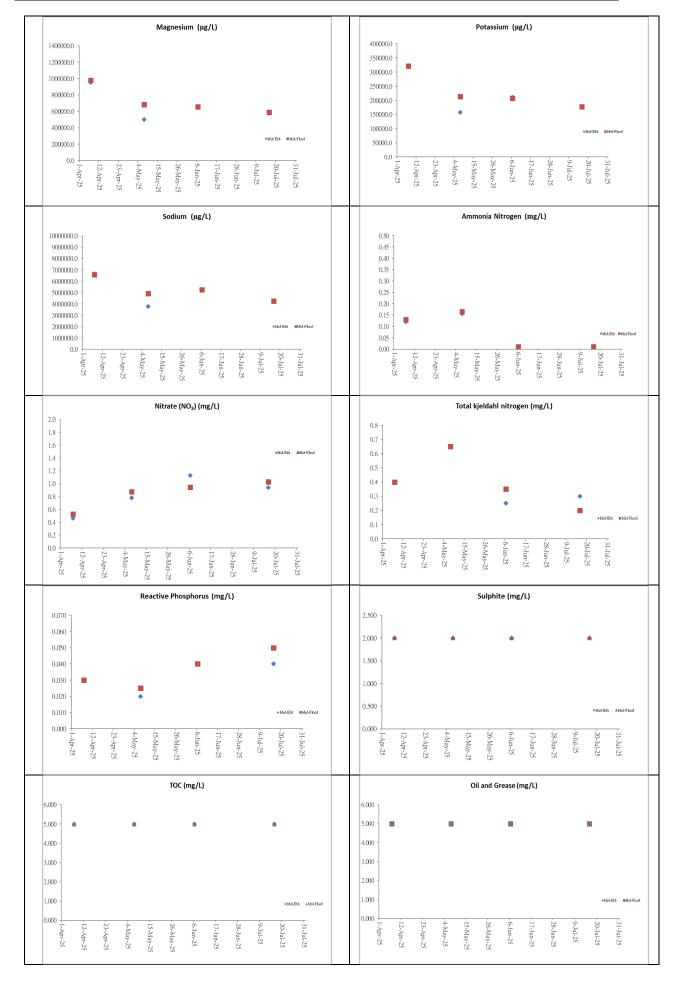



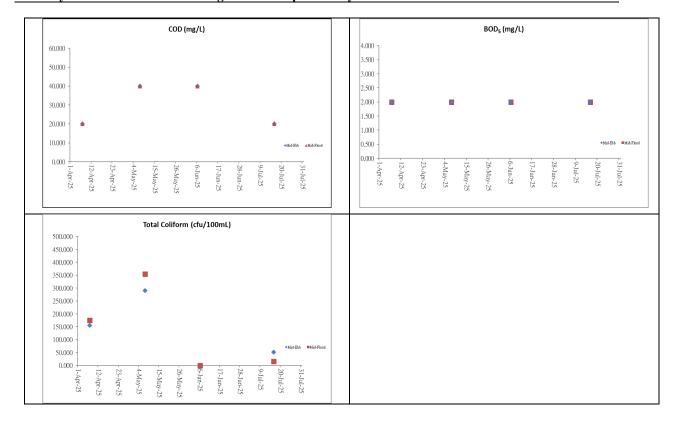



Appendix K

Waste Flow Table

Monthly Summary Waste Flow Table

(Specification Part A Clause 1.16.5.4 refers)

Name of Department: EPD Contract No.: EP/SP/186/21 West New Terriories Landfill Extension

Monthly Summary Waste Flow Table for 2025 (year)

		Actual Quant	ites of Inert C&I	O Materials Gene	erated Monthly				Actual Quantites	s of C&D Waste	Generated Mon	thly	
	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics	Chemic	al Waste	Yard Waste	Others, e.g. general refuse
Month	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in kg)	(in kg)	(in kg)	(in liter)	(in '000kg)	(in tonne)	(in '000m3)
2023 to 2024	431.565	0.000	352.899	77.757	0.909	203.854	103808.200	93.800	18.300	0.000	1.200	6987.860	10.954
Jan	78.657	0.000	48.194	29.541	0.922	3.648	0.000	3.100	0.600	60520.000	0.000	108.830	0.235
Feb	61.073	0.000	44.617	16.456	0.000	1.724	0.300	0.000	0.800	0.000	0.000	46.940	0.159
Mar	72.501	0.000	45.131	27.370	0.000	5.330	0.000	0.000	0.800	0.000	0.000	12.150	0.075
Apr	37.368	0.000	23.836	13.532	0.000	0.982	0.200	7.500	1.000	0.000	0.000	13.810	0.069
May	58.022	0.000	38.608	19.414	0.000	0.237	0.300	3.900	1.600	0.000	0.000	19.440	0.242
Jun	25.409	0.000	4.572	20.837	0.000	0.601	0.000	0.000	0.000	0.000	0.000	0.000	0.172
Sub-Total	764.596	0.000	557.857	204.907	1.831	216.376	103809.000	108.300	23.100	60520.000	1.200	7189.030	11.907
Jul	14.730	0.000	3.962	10.768	0.000	0.134	0.100	1.700	2.100	0.000	0.000	20.610	0.231
Aug													
Sep													
Oct													
Nov													
Dec													
Total	779.326	0.000	561.819	215.675	1.831	216.510	103809.100	110.000	25.200	60520.000	1.200	7209.640	12.138

Note:

- (1) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials
- (2) Project Commenced in Sep 2023.
- (3) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m3.
- (5) Density values and Bulk Factors adopted:

Hard Rock (reuse in the contract) and Large Broken Concrete: 2.5 T/m³(in-situ) Imported Rock: 2.0 T/m³ Soil/Fill: 2.0 T/m³ (in-situ) Imported Soil / Import Public Fill: 1.8 T/m³

General Refuse: 900 Kg/m³ Imported Sand: 1.6 T/m³

(6) Yard Waste is sent to Y Park as recyclable.



Appendix L

Environmental Complaints Log



Environmental Complaint Log

Ι	Date of	Date of Received by ET	Complaint Location	Complainant	Complaint nature	Channel	Ref.	Complaint details	Follow up action	Statue	Investigation Report Ref.
	25 June 2025	26 June 2025	Portion A I	Ha Pak Nai Village Head		Project's PR Team	NA		Enhance Dust mitigation measures	Completed	TCS01325_F0125



Appendix M

Environmental Mitigation Implementation Schedule

Appendix B1 – Air Quality

		Appendix B1 – Ali Qua					
EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Air Qualit	ty			T	T	T	
S3.8.1	A1	 The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation. Dust emission from construction vehicle movement is confined within the worksites area. Watering facilities will be provided at every designated vehicular exit point. Watering will be carried out 8 times per day during construction phase. 	site practices to control the dust impact at the nearby sensitive receivers to		Entire WENT Landfill Extension site		• To control the dust impact to within the EM&A criteria (Ref. 1-hr and 24-hr TSP levels are 500µgm ⁻³ and 260µgm ⁻³ , respectively)
S3.8.2	A2	 The following measures shall be exercised for stack discharge from Ammonia Stripping Plant (ASP), Flare and LFG Power Generator: The maximum allowable discharge limit and pollutant removal efficiency for ASP, flare and LFG power generator should be specified in the design specification. Owing to the requirement for the installation of stack, the design requirement shall be submitted to IEC and SM for vetting by the Contractor. Subject to the subsequent EPD's requirement on chimney installation, regular stack monitoring of air pollutants, including NOx, SO2, RSP, NMOCs, vinyl chloride, and benzene shall be carried out at a quarterly interval (i.e. once every 3 months), and the operating conditions, including exhaust gas temperature and velocity shall be monitored continuously in order to demonstrate compliance during the operations. A monthly monitoring report should be prepared by ET and submitted to IEC and SM for approval. 	Minimize the release of harmful air pollutant to the atmosphere		LFG Power	Design, Operation and Restoration phases	• TM-EIA, Annex 4

EIA Ref	0.00	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A3	 The following measures shall be exercised for the VOC surface emission: The arrangement of the landfill gas collection system and surface covering material for inactive tipping area shall be reviewed by Contractor every 5 years to identify any modern technology/arrangement (covering material, LFG well spacing and locations). A working team shall be formulated to review all processes, control practice and extraction system in order to maximize the efficiency of the system. A review report should be prepared by the Contractor for the submission to SM and IEC on the implementation/arrangement of LFG extraction system. The first review report should be submitted to SM and IEC for agreement before commencement. With a good system to collect LFG (high extraction efficiency), surface release of VOC to the nearby environment can be much reduced or utilised. Maintain a slightly negative pressure within the entire tipping area (by suction). Minimise any potential leakage of LFG to the surrounding by increase the number of gas-extraction wells. Improve the extraction efficiency by checking/reinstate gas wells with abnormally low extraction rate due to blockage/soil movement or sedimentation. Increase the coverage of inactive tipping phases with HDPE/plastic sheet which can enhance the anaerobic decomposition (reduce air getting in and VOC leaking out). EM&A will be conducted at ASR to establish the future VOC ambient level. This monitoring work should be carried out in a frequency once every 3 months. By comparing the monitoring data at the boundary and at ASR, the cause of VOC and the general downwind dispersion effect (dilution effect) from the boundary to the ASR can be identified. The findings of the monitoring should be incorporated into the landfill gas collection system review report as mentioned above. 	Minimize the release of harmful VOC to the environment		Active, Inactive and Restored Tipping areas	Design, Before commencement of Operation, Operation and Restoration phases	• TM-EIA, Annex 4

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A4	 The following design options shall be considered in the future leachate treatment plants: Adopted updated treatment method such as Sequencing Batch Reactor for future leachate treatment. Provision of ventilated cover for the leachate storage lagoons / tanks and emissions extracted to suitable odour removal filters with odour removal efficiency of 99%. Ferric nitrate or sodium hypochlorite can be added to oxidise the odourous chemical in the leachate. The pH value of leachate can be controlled to a suitable value from future onsite experiment such that the generation of any odourous H₂S and ammonia can be optimised. The locations of discharge points and discharge heights should be in accordance with the assumptions adopted in the EIA Report and VEP supporting document. If the future locations / heights of the stacks deviate from the assumptions adopted in the EIA Study VEP supporting document, reassessment of the air quality impact should be conducted. The overall arrangement should be investigated in details by the Contractor and agreed with IEC and EPD. 	Enhancement to improve the air quality and visual impact to nearby sensitive receivers	Contractor	Leachate treatment plants	Design, Operation and Restoration phases	• Environmental Enhancement
S3.8.2	A5	 The following are some odour precautionary measures that shall be considered by EPD and FEHD: As an improvement measure to enhance to environmental standard for waste transfer, EPD could take the initiative to recommend others to use enclosed type RCV in the long run (dominantly government and sludge types). Clearing / watering of the surface and clearing of the waste water receptor of government RCV is recommended before leaving refuse transfer station or government Refuse Collection Point (FEHD). 	Enhancement to improve the odour impact during the transit of waste	EPD, FEHD	Government Refrom RTS and RCP	Operation phase	• Environmental Initiative

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A6	The Contract shall exercise adequate precautionary measures to minimize any potential odour nuisance from tipping activities: Planting rows of trees along the northern side of WENT Landfill Extension (ie slope toe) and along Nim Wan Road. Providing a vehicle washing facility before the exit of the landfill and providing sufficient signage to remind Refuse Collection Vehicles (RCV) drivers to pass through the facility before leaving the landfill. Reminding the RCV drivers to empty the liquor collection sump and close the valve before leaving the tipping face. Washing down the area where spillage of RCV liquor is discovered promptly. Reminding operators to properly maintain their RCVs properly and that liquor does not leak from the vehicles. Installation of vertical and/or horizontal LFG extraction system to enhance extraction of LFG from the waste mass and hence minimise odour associated with fugitive LFG emissions. Progressive / temporary restoration of the areas which reach the finished profile (a final capping system including an impermeable liner will be put in place) and installation of a permanent LFG extraction system. Daily cover the compacted waste with 150mm of soil. Covering the non-active phase with 300mm to 600mm of soil / an impermeable liner (on top of the intermediate cover), which will not only prevent odour emissions from landfilled waste but also enhance LFG extraction by the LFG extraction system. Providing deodoriser for the LTP. Enclosing all the leachate storage and treatment tanks and diverting the exhaust air from these tanks to a deodoriser to avoid potential odour emissions from the LTP. As an improvement measure to enhance to environmental standard for waste transfer, EPD could take the initiative to recommend others to use enclosed type RCVs (dominantly government vehicles and sludge vehicles).	Minimize the potential odour impact for tipping area to nearby sensitive receivers	Contractor	Tipping areas	Operation and Restoration phases	TM-EIA, Annex 4 Odour patrol with 2 Odour Level or below at ASR without causing potential odour nuisance

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	meggiireg	When to implement the measures?	What requirements or standards for the measures to achieve?
	Ref	 Cleaning / watering of the surface and clearing of the waste water receptor of government RCV is recommended before leaving refuse transfer station or government Refuse Collection Point (FEHD). The trench for special waste shall be covered with soil immediately upon the disposal of special waste to reduce the odour emission. For Waste requiring co-disposal (e.g., special waste) by trench, the open trench shall be covered with a mobile de-odouriser cover when the trench is not in use for waste disposal, including the time interval between two consecutive disposal operations. The use of alternative daily cover (less permeable layer) instead of inert material should be considered under worst-case weather condition, subject to EM&A Programme. The use of immediate daily cover for odorous waste such as animal waste etc. under critical condition should also be considered, subject to EM&A Programme. In accordance with some reference from New Zealand, odour from active tipping area can be much reduced if the waste is covered by sandwich covering material such that it is confined in a solid/semi solid condition. Such covering material will be acted as sandwich protective layers to block the interaction of waste. Only diffusion mode (small scale) will be present. These would be applied during very hot and stable weather condition. Twice daily covering (mid day and close of business) can be arranged in case odour patrol identify potential odour nuisance, subject to EM&A Programme. Posi-shell and/or other suitable materials will be applied to cover the active tipping face at the end of each operation day according to the 		measures?		measures?	measures to achieve?
		 Enhanced Scheme. There will also be immediate cover of 300 mm thick soil on the special trench for special wastes. 					

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A6 (Con't)	 Continue to maintain the integrity of the capping system. Provision of vertical and/or horizontal LFG extraction system to enhance extraction of LFG from the waste mass and hence minimise odour associated with fugitive LFG emissions. Enclosing all the leachate storage and treatment tanks and diverting the exhaust air from these tanks to a deodoriser to avoid potential odour emissions from the LTP. 	Minimize the potential odour impact for tipping area to nearby sensitive receivers		Entire WENT Landfill Extension Site	Aftercare phase	 TM-EIA, Annex 4 Odour patrol with 2 Odour Level or below at ASR without causing potential odour nuisance
Specific me	easure from	ı VEP					
		 Regular watering on construction / restoration workfronts, haul roads, stockpiling areas etc (at least once per hour). The quantity of explosive used at each time and spacing of shot holes shall be carefully designed. Blast nets, screens and other protective covers shall be adopted to prevent any fly rocks resulting from blasting activities. The areas within 30 m from the blasting area will be wetted with water prior to blasting, Blasting shall not be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted. Water spraying shall be conducted immediately after each blasting to avoid dispersion of dust. For marine emissions, on-shore power supply shall be provided where practicable for the construction barges and marine vessels to power the cranes and other machinery on the barges / vessels at the berths to avoid emission from idling at the berth. The crushers, including the inlets and outlets will be enclosed and ducted to a dust extraction and collection system such as fabric filter in accordance with "A Guidance Note on the Best Practicable Means for Mineral Works (Stone Crushing Plants) (BPM 11/1(95))". All transfer points and conveyor belts will also be enclosed. Water spraying system will be installed at all feeding and outlet areas to 	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.		Entire WENT Landfill Extension site	Construction and Restoration phases	• To control the dust impact to within the EM&A criteria (Ref. 1-hr and 24-hr TSP levels are 500µgm ⁻³ and 260µgm ⁻³ , respectively)

EIA Ref	1 00	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Recommended	Who to implement the measures?	Location of the	When to implement the measures?	What requirements or standards for the measures to achieve?
		further suppress dust emission. The contractor shall also apply and obtain the license from EPD for operation of the rock crushing plants under the Air Pollution Control Ordinance and ensure the rock crushing plants designed and operated in accordance with BPM 11/1(95). • Posi-shell and/or other suitable materials will be applied to cover the active tipping face at the end of each operation day according to the Enhanced Scheme. • There will also be immediate cover of 300 mm thick soil on the special trench for special wastes.					

Notes:

Entire WENT Landfill Extension site includes Office, Waste Reception Area, Leachate Treatment Works, LFG Treatment Works, Active, Inactive and Restored Tipping Areas.

Appendix B2 – Noise

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Constructi	on Noise						
S4.4.3.1	N1	Use of good site practices to limit noise emissions by considering the following: only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme;	Control construction airborne noise by means of good site practices	Contractor	Entire site construction	Construction phase	• Noise Control Ordinance
		machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;					
		• plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;					
		• silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works;					
		• mobile plant should be sited as far away from NSRs as possible and practicable;					
		• material stockpiles, mobile container site officer and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities.					
S4.4.3.2	N2	Select "Quiet plants" which comply with the BS 5228 Part 1 or TM standards.	Reduce the noise levels of plant items	Contractor	Entire site construction	Construction phase	• Noise Control Ordinance & its TM • Annex 5, TM-EIA
Operation	Noise						
S4.6.2	N3	Select "Quiet plants" which comply with the BS 5228 Part 1 or TM standards.	Reduce the noise levels of plant items	Contractor	Entire site construction	Operation and Restoration phases	• Noise Control Ordinance & its TM • Annex 5, TM-EIA
S4.6.2	N4	Build a noise bund of about 3.5m tall along the north eastern seafront of the existing WENT Landfill to provide a screening effect of at least 5dB(A) from the berths.	Reduce the noise levels of barges	Contractor	Existing Landfill WENT	Construction, operation and restoration phases	• Noise Control Ordinance & its TM • Annex 5, TM-EIA

Appendix B3 – Water Quality

EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
n Water Q	quality					
W1	 Construction Runoff At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and crosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a site/sediment trap. The sediment/silt traps should be incorporated in the permanent drainage channels to enhance deposition rates. The design of efficient silt removal facilities should be based on the guidelines in ProPECC PN 2/23, which states that the retention time for silt/sand traps should be 5 minutes under maximum flow conditions. Construction works should be programmed to minimize surface excavation works during the rainy seasons (April to September). All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed slope surfaces should be covered by tarpaulin or other means. All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas. Measures should be taken to minimise the ingress of site drainage into excavations. If the excavation of trenches in wet periods is necessary, they should be dug and backf	Control construction runoff and erosion from site surface, drainage channel, stockpiles, barging facility, wheel washing facilities, etc to minimize water quality during construction stage	Contractor	Entire construct	Construction phase	ProPECC PN 2/23 Water Pollution Control Ordinance
] F	Log Ref Water Q	Water Quality Construction Runoff	Recommended (to be implemented when the trigger level is exceeded, where necessary) Water Quality Construction Runoff	Recommended Precautionary Mitigation Measures Measures	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary) Recommended Measures & Main Concerns to address	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary) Water Quality // Construction Rumoff

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system. Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers. Precautions to be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC PN 2/23. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes. All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing bay should be provided at every construction site exit. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. Oil interceptors should be provided in the site drainage system downstream of any oil/fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain. Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts. Requirements for solid waste management are detailed in Section 6 of this Report. All fuel tanks and storage areas s					achieve?
		sensitive receivers nearby.					

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
\$5.6.7	W2	 Sewage Effluent from Workforce Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. Notices will be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the Project. Regular environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site. 	Control sewage effluent arising from the sanitary facilities provided for the onsite construction workforce	Contractor	On-site sanitary facilities	Construction phase	ProPECC PN 2/23 Water Pollution Control Ordinance Waste Disposal Ordinance
S5.6.7	W3	Accidental Spillage of Chemical Any service workshop and maintenance facilities shall be located within a bunded area, and sumps and oil interceptors shall be provided. Maintenance of equipment involving activities with potential for leakage and spillage will only be undertaken within the areas.	Control of chemical leakage	Contractor	Service workshop and maintenance facilities	Construction phase	ProPECC PN 2/23 Water Pollution Control Ordinance Waste Disposal Ordinance

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?	
Operation	ı Water Qı	uality						
S5.7.8	W4	Erosion Control Measures a. Preserve Natural Vegetation	Erosion control	Contractor		Construction, Operation, Restoration and Aftercare phases	ProPECC PN 2/23 Water Pollution	
		This Best Management Practices will involve preserving natural vegetation to the greatest extent possible during the construction process, and after construction where appropriate. Maintaining natural vegetation is the most effective and inexpensive form of erosion prevention control.				F	Control Ordinance	
		b. Provision of Buffer Zone						
		A buffer zone consists of an undisturbed area or strip of natural vegetation or an established suitable planting adjacent to a disturbed area that reduces erosion and runoff. The rooted vegetation holds soils acts as a wind break and filters runoff that may leave the site.						
		c. Seeding (Temporary/Permanent)						
		A well-established vegetative cover is one of the most effective methods of reducing erosion. Vegetation should be established on construction sites as the slopes are finished, rather than waiting until all the grading is complete. Besides, Hydroseeding will be applied on the surface of stockpiled soil and on temporary soil covers for inactive tipping areas to prevent soil erosion during rainy season.						
		d. Ground Cover						
		Ground Cover is a protective layer of straw or other suitable material applied to the soil surface. Straw mulch and/or hydromulch are also used in conjunction with seeding of critical areas for the establishment of temporary or permanent vegetation. Ground cover provides immediate temporary protection from erosion. Mulch also enhances plant establishment by conserving moisture, holding fertilizer, seed, and topsoil in place, and moderating soil temperatures.						
		e. Hydraulic Application						
		Hydraulic application is a mechanical method of applying erosion control materials to bare soil in order to establish erosion-resistant vegetation on disturbed areas and critical slopes. By using hydraulic equipment, soil amendments, mulch, tackifying agents, Bonded Fiber Matrix (BFM) and liquid co-polymers can be uniformly broadcast, as homogenous slurry, onto the soil. These erosion and dust control materials can often be applied in one operation.						

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		f. Sod					
		Establishes permanent turf for immediate erosion protection and stabilizes rainageways. g. Matting					
		There are numerous erosion control products available that can be described in various ways, such as matting, blankets, fabric and nets. These products are referred as matting. A wide range of materials and combination of materials are used to produce matting including, but not limited to: straw, jute, wood fiber, coir (coconut fiber), plastic netting, and Bonded Fiber Matrix. The selection of matting materials for a site can make a significant difference in the effectiveness of the Best Management Practices. h. Plastic Sheeting					
		Plastic Sheeting will provide immediate protection to slopes and stockpiles. However, it has been known to transfer erosion problems because water will sheet flow off the plastic at high velocity. This is usually attributable to poor application, installation and maintenance. i. Dust Control					
		Dust Control is one preventative measure to minimize the wind transport of soil, prevent traffic hazards and reduce sediment transported by wind and deposited in water resources.					
S5.7.8	W5	Temporary surface water drainage system will be provided to manage runoff during construction and operation. This system will consist of channels as constructed around the perimeter of the site area. This system will collect surface water from the areas of higher elevations to those of lower elevations and ultimately to the point of discharge. Erosion will therefore be minimised.	Surface Water Managemo	Contractor	Surface water system	Construction, Operation, Restoration and Aftercare phases	Water Pollution Control Ordinance TM-water
		The temporary surface water drainage system will include the use of a silt fence around the soil stockpile areas to prevent sediment from entering the system. Regular cleaning will be carried out to prevent blockage of the passage of water flow in silt fence.					
		Intermediate drainage system will be installed for filled cell/phase. The major purpose of the intermediate drainage system is to prevent the clean surface water run-off from the filled phases coming into contact with the waste mass in active cell and to prevent excessive surface water infiltration through the intermediate cover, thus contribute to increasing volume of leachate. The intermediate drainage system will collect the clean surface water run-off and					

EIA Ref		Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	l	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		divert it to the permanent discharge channels connected to the public drainage system. In addition, surface flow from the haul road (especially near the wheel washing facility) will be collected to a dry weather flow interceptor and conveyed to the on-site leachate treatment plant for further treatment.					
S5.7.8	W6	Monitoring of the surface water discharges and groundwater discharge under the environmental monitoring programme.	Control run off and underground water leakage	Contractor	Surface and underground water system	Restoration and	Water Pollution Control Ordinance TM-water
S5.7.8	W7	 Formulate contingency Plan on Accidental Leakage of Leachate Design Contingency Plan for Groundwater Contamination Design Contingency Plan for Surface Water Contamination 	Control contamination to surface and ground water	Contractor	Drainage system	Restoration and	TM-water Water Pollution Control Ordinance

Appendix B4 – Waste Management

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Waste Man	agement						
S6.5	WM1	C&D Materials Implement proper waste management measures during construction phase as stipulated in the Environmental Management Plan (EMP) in accordance with the ETWB TC(W) No. 19/2005 Environmental Management in Construction Sites. Implement a trip-ticket system to ensure that the movement of C&D materials are properly documented and verified in accordance with TCW No. 6/2010. Copies/counterfoils from trip-tickets (with quantities of C&D Materials off-site) should be kept for record purposes. Appropriate waste management should be implemented in accordance with the ETWB TC(W) No 19/2005. Make provisions in Contract documents to allow and promote the use of recycled aggregates where appropriate. Careful design, planning and good site management to minimise overordering and waste materials such as concrete, mortars and cement grouts. The design of formwork should maximise the use of standard wooden panels so that high reuse levels can be achieved. Alternatives such as steel formwork or plastic fencing should be considered to increase the potential for reuse. The Contractor should recycle as much as possible the C&D waste on-site through proper waste segregation on-site. Concrete and masonry should be used as general fill and steel reinforcement bars can be used by scrap steel mills. Proper areas should be designated for waste segregation and storage wherever site conditions permit. Maximise the use of reusable steel formwork to reduce the amount of C&D material. Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement. On-site sorting and segregation facility of all type of wastes is considered as one of the best practice in waste management and hence, should be implemented in all projects generating construction waste. The sorted public fill and C&D waste should be properly reused. Excavated slope, stockpiled material and bund walls should be covered by tarpaulin until used in order to prevent wind-blown dust during dry weather, and to reduce muddy runoff during	Good site practice to minimise C&D waste generation and reuse/recycle all C&D on-site as far as possible	Contractor	Entire construction site	phase	Waste Disposal Ordinance ETWB TC(W) No.19/2005 TCW No. 6/2010

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		consideration should be given to hydroseeding of the topsoil on the stockpile to improve its visual appearance and prevent soil erosion.					
		Nomination of approved personnel to be responsible for good site practices and making arrangements for collection of all wastes generated on-site and effective disposal.					
		Training of site personnel for cleanliness, proper waste management procedures including chemical waste handling, and waste reduction, reuse and recycling concepts.					
		Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors.					
		Prior to disposal of C&D waste, wood, steel and other metals should be separated for re-use and/or recycling to minimise the quantity of waste to be disposed of to landfill. Proper storage and site practices should be implemented to minimise the potential for damage or contamination of construction materials.					
		Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste. Minimise excessive ordering of concrete, mortars and cement grout by doing careful check before ordering.					
06.5	WD 62		P.				W
S6.5	WM2	Chemical Waste Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Plant/equipment maintenance schedule should be designed to optimise maintenance effectiveness and to minimise the generation of chemical wastes. Where possible, chemical wastes (e.g. waste lube oil) should be recycled by licensed treatment facilities	Ensure proper disposal of chemical waste generated on-site to minimise the associated hazards on human health and environment	Contractor	Entire construction site	Construction, Operation, Restoration and Aftercare phases	Waste Disposal (Chemical Waste) General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste
		Containers used for storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; have a capacity of less than 450 liters unless the specification has been approved by the EPD. Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Regulation.					
		The storage area for chemical wastes should be clearly labelled and used solely for storage of chemical waste, enclosed with at least 3 sides, having an					

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements of standards for the measures achieve?
		impermeable floor and bund of sufficient capacity to accommodate 110% of volume of the largest container or 20 % of total volume of waste stored in that area, whichever is the greatest, having adequate ventilation, being covered to prevent rainfall entering, and being arranged so that incompatible materials are adequately separated.					
		Chemical waste should be collected by licensed waste collectors and disposed of at licensed facility, e.g. Chemical Waste Treatment Centre.					
S6.5	WM3	General Refuse General refuse generated on-site should be properly stored in enclosed bins or compaction units separately from construction and chemical wastes. All recyclable materials (separated from the general waste) should be stored onsite in appropriate containers with cover prior to collection by a local recycler for subsequent reuse and recycling. Residual, nonrecyclable, general waste should be stored in appropriate containers to avoid odour. Regular collection should be arranged by an approved waste collector in purpose-built vehicles that minimise environmental impacts during transportation Reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimise odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminum cans should be separated from general waste stream and collected by recyclers. Proper collection bins should be provided on-site to facilitate the waste sorting. Office waste paper should be recycled if the volume warrant collection by recyclers. Participation in community waste paper recycling programme should be considered by the Contractor, including waste paper, aluminum cans, plastic bottles, waste batteries, etc.	Minimise generation of general refuse to avoid odour, pest and visual nuisance	Contractor	Entire construction site	Construction, Operation, Restoration and Aftercare phases	Waste Disposa Ordinance
S6.5	WM4	Sludge from Leachate Treatment Works Sludge should be collected by a licensed collector at regular intervals, to suit the operation schedule of the leachate treatment plant. The use of purpose-built sludge tankers can minimise the potential of environmental impacts during transportation.	Proper management of sludge arising from leachate treatment works to minimise the associated hazards on human health and environment	Contractor	Leachate Treatment Works	Construction, Operation, Restoration and Aftercare phases	Waste Disposa Ordinance

Appendix B5 – Landfill Gas

		Recommended Precautionary / Mitigation Measu	Objectives of the	Who to	_	When to	What requirements or
EIA Ref	Log Ref	(to be implemented when the trigger level is exceeded, where necessary)	Recommended Measures & Main Concerns to address	implement the measures?	Location of the measures	implement the measures?	standards for the measures to achieve?
LFG							
_		ndfill Extension	T		I		
S7.6.1	LFG1	Special LFG precautions should be taken due to close proximity of WENT Landfill Extension site to existing landfill to avoid potential hazards of LFG exposure (ignition, explosion, asphyxiation, toxicity).	To minimise the risk of LFG hazards to personnel in construction site	Contractor	Entire WENT Landfill Extension site	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97)
	LFG2	Prominent safety warning signs should be erected on-site to alert all personnel and visitors of LFG hazards during excavation works.					Factories and Industrial Undertakings (F&IU) (Confined
S7.6.1	LFG3	No smoking or burning should be permitted on-site.					Spaces) Regulations
S7.6.1	LFG4	Prominent 'No smoking' and 'No Naked Flames' signs should be erected on-site.					Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.1	LFG5	No worker should be allowed to work alone at any time in excavated trenches or confined areas on-site.					
S7.6.1	LFG6	Adequate fire fighting equipment should be provided on-site.					
S7.6.1	LFG7	Construction equipment should be equipped with vertical exhaust at least 0.6m above ground installed with spark arrestors.					
S7.6.1	LFG8	Electrical motors and extension cords should be explosion-proof and intrinsically safe for use on-site.					
S7.6.1	LFG9	'Permit to Work' system should be implemented.					
S7.6.1	LFG10	Welding, flame-cutting or other hot works should be conducted only under 'Permit to Work' system following clear safety requirements, gas monitoring procedures and presence of qualified persons to supervise the works.					
S7.6.1	LFG11	For piping assembly or conduit construction, all valves and seals should be closed immediately after installation to avoid accumulation and migration of LFG. If installation of large diameter pipes (diameter >600mm) is required, the pipe ends should be sealed on one side during installation. Forced ventilation is required prior to operation of installed pipeline. Forced ventilation should also be required for works inside trenches deeper than 1m.					

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measu (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S7.6.1	LFG12	Frequency and location of LFG monitoring within excavation area should be determined prior to commencement of works. LFG monitoring in excavations should be conducted at no more than 10mm from exposed ground surface.	To minimise the risk of LFG hazards to personnel in construction site	Contractor	Entire WENT Landfill Extension site	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and
S7.6.1	LFG13	For excavation works deeper than 1m, LFG monitoring should be conducted (1) at ground surface prior to excavation, (2) immediately before workers entering excavations, (3) at the beginning of each working day for the entire period of excavation remains open, and (4) periodically throughout the working day when workers are in the excavation.					Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined
S7.6.1	LFG14	Any cracks on ground level encountered on-site should be monitored for LFG periodically. Appropriate action should be taken in accordance with the action plan in Table 7.8 of EIA Report.					Spaces
S7.6.1	LFG15	LFG precautionary measures involved in excavation and piping works should be provided in accordance with LFG Guidance Note and included in Safety Plan of construction phase. Temporary offices or buildings should be located where free LFG has been proven or raised clear of ground at a separation distance of at least 500mm.					
S7.6.1	LFG16	For large development such as WENT Landfill Extension, a Safety Officer trained in the use of gas detection equipment and LFGrelated hazards should be present on-site throughout the groundwork phase. The Safety Officer should be provided with an intrinsically safe portable instrument appropriately calibrated and capable of measuring the following gases: • CH4: 0-100% LEL and 0-100% v/v • CO2: 0-100% v/v • O2: 0-21% v/v					

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measu (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S7.6.1	LFG17	Periodically during groundwork construction, the works area should be monitored for CH ₄ , CO ₂ and O ₂ using appropriately calibrated portable gas detection equipment. The monitoring frequency and areas should be established prior to commencement of groundwork either by Safety Officer or appropriately qualified person. Routine monitoring should be carried out in all excavations, manholes, chambers and any other confined spaces that may have been created by temporary storage of building materials on-site. All measurements in excavations should be made with monitoring tube located not more than 10mm from exposed ground surface.	To minimise the risk of LFG hazards to personnel in construction site	Contractor	Entire WENT Landfill Extension site	•	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.1	LFG18	For excavations deeper than 1m, measurements should be conducted: • At ground surface before excavation commences; • Immediately before any worker enters the excavation; • At the beginning of each working day for entire period the excavation remains open; and • Periodically throughout the working day whilst workers are in excavation.					
S7.6.1	LFG19	For excavations between 300mm and 1m, measurements should be conducted: • Directly after excavation has been completed; and • Periodically whilst excavation remains open.					
S7.6.1	LFG20	For excavations less than 300mm, monitoring may be omitted at the discretion of Safety Officer or appropriately qualified person.					
S7.6.1	LFG21	Where any service voids, manholes and inspection chambers within WENT Landfill Extension site are entered for maintenance and LFG monitoring, all safety requirements should be followed.	To minimise the risk of LFG hazards to personnel in landfill site	Contractor		Construction, Operation, Restoration and Aftercare phases	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97)
S7.6.1	LFG22	Buildings onsite should be incorporated with passive system relying on natural air movement to prevent gas build-up and active system requiring energy input to mechanically move air to protect against LFG build-up. Design measures for sub-surface building services should include generic measures e.g. gas barriers, gas vents and strategic routing of any service utilities away from potential LFG migration pathways.					Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measu (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S7.6.1	LFG23	Any new-built permanent building structures within the WENT Landfill Extension site, forced ventilation and gas detection system with audible alarm should be installed. When the internal atmosphere is detected with >10% of CH4, forced ventilation should be triggered automatically. No person should be allowed to enter or remain in any confined areas when CO ₂ levels >1.5% v/v or O ₂ levels <18% v/v were detected. Access to confined spaces in the WENT Landfill Extension site should be controlled to only authorised persons.	To minimise the risk of LFG hazards to personnel in landfill site	Contractor	Entire WENT Landfill Extension site	Construction, Operation, Restoration and Aftercare phases	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined
S7.6.1	LFG24	Specific gas protection measures which can be applied to building services have been in Appendix 7.4 of EIA Report. They generally include gas barriers, gas vents, location of service entries above ground, and service conduits passing through Consultation Zone.					Spaces
\$7.6.3	LFG25	The design of the landfill gas protection measures to be adopted onsite, e.g. utilities, buildings, LFG cut-off trench barrier, monitoring wells and facilities related to the WENT Landfill Extension project will be performed by a landfill gas specialist consultant appointed by the Contractor. Moreover, the landfill gas protection measures will be checked and certified by a qualified independent consultant. The contractor shall ensure that the required protective measures are implemented and constructed in accordance with the design and shall establish a maintenance and monitoring programme for ensuring the continual performance of the implemented protection measures. The above requirements shall be included in the tender documents of WENT Landfill Extension project.	To ensure that the design of the landfill gas protection measures is in order and appropriate.	The Project Proponent, Contractor	Entire WENT Landfill Extension site	Detailed Design stage	
		When the detailed design is available, the Contractor is required to undertake further landfill gas hazard assessment to take account of the more readily available detailed information to finalise the design of the landfill gas protection measures recommended in this report. During the future detailed design stage, a review of the preliminary qualitative LFG hazard assessment presented in the report will be carried out, a detailed qualitative LFG hazard assessment will be prepared and all the report together with the detailed design of gas protection measures will be submitted to EPD for vetting.					

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Mea (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?				
Outside W	Outside WENT Landfill Extension										
S7.6.2	LFG26	Setting up a LFG cut-off trench barrier is one of the mitigation measures for preventing gas entering an area. Since there are no "design equations' for cut-off barrier specifications, it is therefore essential to seek expert recommendation before finalising the design detail of any cut-off barrier. LFG cut-off trench barrier should be built along the site boundary of the WENT Landfill Extension to prevent gas from entering an area, which is keyed into low permeability strata or extends at least 1m below the lowest groundwater level. To relieve the potential build up of gas, it may be necessary to install additional measures for venting the gas such as trenches filled with nofines, granular material, e.g. gravel, connected to venting pipes which will provide a preferential pathway for the release of gas to atmosphere.	migration from WENT Landfill Extension to the middle lagoo and T Park which falls into the 250m LFG consultation zone of WENT Landfill and its Extension.	Contractor	Outside WENT Landfill Extension site	1	Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces				
S7.6.2	LFG27	 Sealing of fault line ends by grouting will be implemented. In the event that investigation works during the detailed design stage identify the presence of laterally persistent faults running beneath the landfill site, and leading towards sensitive receivers, the following works could be carried out: Sealing of any surface exposures of the 'fault' feature exposed during the site formation works. This could be carried out through the application of a shotcrete cover prior to the placement of the landfill liner, which also acts as a barrier to landfill gas migration. Ground treatment at the landfill boundary, comprising pressurized injection of grout within a series of inclined drillholes formed to intersect the fault at various depths. These would effectively form an impermeable barrier against the lateral migration of landfill gas along the fault line. Adequate venting of landfill gases such that insufficient pressures develop to result in lateral or downward migration of gas. 	migration through the fault line in particular to the existing Black Point Power Station.	Contractor	Outside WENT Landfill Extension site	1	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces				
S7.6.2	LFG28	LFG monitoring wells will be installed in the ground on the development side of the cut-off trench barrier to measure the concentration of methane and carbon dioxide. Setting up a LFG cut-off trench barrier is one of the mitigation measures for preventing gas entering an area. Since there are no "design equations' for cut-off barrier specifications, it is therefore	effectiveness of the cut- off trench barrier in preventing LFG migration.	Contractor	Outside WENT Landfill Extension site	Construction, Operation, Restoration and Aftercare phases	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97).				

essential to seek expert recommendation before finalising the design detail of any cut-off barrier.			

Appendix B6 – Landscape and Visual Impact

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location of Measures	. When to Implement Measures?	What Requirements or Standards for Measures to Achieve?					
Landscape	and Visuo	al Impact										
S8.7	LV1	Advanced screening tree planting (mitigation measures – MM1) Early planting using fast growing trees and tall shrubs at strategic locations within site to block major view corridors to the site from the VSRs, and to locally screen haul roads, excavation works and site preparation works. Tree planting in standard tree size along the slope toe of WENT Landfill Extension.	retained by personnel in	Contractor	Entire construction site	Construction and Operation phases	DEVB TC(W) No. 4/2020 – Tree Preservation ETWB TC(W) No. 6/2015 – Maintenance of Vegetation and Hard					
S8.7	LV2	Boundary Green Belt planting (mitigation measures – MM2) Considerable planting belts proposed around the site perimeter and the construction of temporary soil bunds would screen the landfill operations to a certain degree. Fast growing and fire resistant plant species will be used.	measures	C	~	Č	~	- C				Landscape Features WBTC No. 6/2011 – Maintenance of Man-made Slopes
S8.7	LV3	Temporary landscape treatment as green surface cover (mitigation measures – MM3) • For certain areas where landfilling operations would have to be suspended temporarily for a certain period of time, simple temporary landscape treatment such as temporary green colour slope cover should be considered. The period of temporary suspended operation should be sufficiently explicit in order to undertake appropriate temporary landscape treatment. During construction and operation phases, synthetic covering material of green colour should also be used as a temporary slope cover where applicable. Given the extensive area of the proposed extension, development of the site should be divided into phases to minimize the visual impact.					and Emergency Repair on Stability of Land					
S8.7	LV4	Existing tree preservation (mitigation measures – MM4) No trees should be felled or transplanted unless they are inevitably affected by the Project. Affected trees should be transplanted under circumstances where technically feasible. A tree survey report should be prepared and a tree felling application should be submitted to government during the detailed design stage for approval before site formation works commence. The numbers, locations, species and sizes of the trees to be transplanted or felled should be clearly addressed.										

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures & Main Concerns to Address	Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
S8.7	LV5	 Sensible final contour grading (mitigation measures – MM5) The final landfill will provide a structurally stable and visually interesting landform, which is visually compatible with surrounding landscape and contoured to simulate adjacent undeveloped area. Introduction and continuation of natural features such as spurs, ridges and valleys will be considered where appropriate. 	To minimise the visual impact on landfill.	Contractor	Entire construction site	Restoration and Aftercare phases	DEVB TC(W) No. 4/2020 – Tree Preservation ETWB TC(W) No. 6/2015 – Maintenance of
S8.7	LV6	 Sufficient cover soil of landfill final capping (mitigation measures – MM6) Sufficient cover soil of landfill final capping will be placed above the low-permeable layer and drainage layer, so as to sustain the proposed planting. The cover soil layer should be a minimum of 500mm in thickness for grassland, a minimum of 700mm for shrubland and 1000mm for woodland. Immediately after the completion of localized earthworks for the cover soil layer, the soil surface should be stabilized and greened by grass hydroseeding prior to subsequent landscape planting. 	To provide site preparation for compensatory planting under the requirements of mitigation measures.	Contractor	Entire construction site	Restoration and Aftercare phases	Vegetation and Hard Landscape Features WBTC No. 6/2011 – Maintenance of Man-made Slopes and Emergency Repair on Stability of Land
S8.7	LV7	 Landscape planting and maintenance (mitigation measures – MM7) Planting and maintenance to allow vegetation establishment to match the natural vegetation of the surroundings. Seedlings of native tree species will be planted in the second phase. Reprovision of mangroves in some suitable locations inside the project boundary for compensation. Planting layout to establish a coherent pattern of woodland, shrubland and grassland vegetation. In the approved WENTX EIA, 21 ha of woodland compensatory planting to be planted after restoration phase. The Enhanced Scheme would largely minimize encroachment onto the woodland resulting in a small area of loss only, i.e. 0.12 ha. In line with the same principle as the approved WENTX EIA (ratio = 5:1 in terms of area), the total compensatory woodland planting area should be around 0.60 ha. 		Contractor	Entire construction site	Restoration and Aftercare phases	

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
S8.7	LV8	 Woodland vegetation management (mitigation measures – MM8) Thinning of pioneer trees to be carried out in the period of 5-8 years after the establishment period for each phase of works. It includes the selective removal of pioneer trees to provide more light and space between trees that is beneficial for growth and natural regeneration of native trees in the woodland planting mix. Proper maintenance and management for woodland planting is required to provide good quality of compensatory planting. During establishment period of the woodland planting, proper inspection of the death rate of each species in terms of quantity shall be provided and stated in Environmental Permit that forms part of DBO contract. 	To maintain the compensatory woodland planting effectively for mitigation measures.	Contractor	Entire construction site	Restoration and Aftercare phases	

Appendix C7 – Cultural Heritage

EIA Ref Log (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures & Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
---	--	-------------------------	-----------------------------------	---

Cultural Heritage Impact

Construction and Operation Phases

Under the Enhanced Scheme, the revised boundary will totally avoid encroachment onto the Tsang Tsui Site of Archaeological Interest, graves and temple. No potential cultural heritage impact due to the Project is anticipated, and thus no mitigation measures are required for the Enhanced Scheme.

Appendix C8 – Ecology

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
Ecology Ganaral F	votaction	Measures:					
S10	E1	Restriction of construction activities to the work areas that would be clearly demarcated.	environmental impacts	Contractor	Entire construction	Construction Phase	Practice Note for Professional Persons
S10	E2	Reinstatement of the work areas immediately after completion of the works.	and therefore potential ecological impacts within		site		(ProPECC), Construction Site Drainage (PN2/23)
S10	E3	Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme.	and near the construction site				Code of Practice on the Packaging, Labeling and
S10	E4	Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.					Storage of Chemical Wastes, EPD (2022) ETWB TC(W)) No. 33/2002
S10	E5	Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs.					Management of Construction and Demolition Material
S10	E6	Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works.					Including Rock TCW No. 6/2010 Trip Ticket
S10	E7	Mobile plant should be sited as far away from NSRs as possible and practicable.					System for Disposal of Construction and Demolition Materials
S10	E8	Material stockpiles, site office and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities.					ETWB TC(W) No. 15/2003 Waste Management on Construction Sites
S10	E9	Use of "quiet" plant and working methods.					WBTC No.12/2002,
S10	E10	Construction phase mitigation measures in the Practice Note for Professional Persons on Construction Site Drainage.					Specifications Facilitating the Use of Recycled Aggregates WBTC Nos. 25/99, 25/99A and
S10	E11	Design and set up of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction.					25/99C. Incorporation of Information on Construction and Demolition Material Management in Public Works
S10	E12	Design and incorporation of silt/sediment traps in the permanent drainage channels to enhance deposition rates and regular removal of deposited silt and grit.					Subcommittee Papers

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
S10	E13	Minimization of surface excavation works during the rainy seasons (April to September), and in particular, control of silty surface runoff during storm events, especially for areas located near steep slopes.					
S10	E14	Regular inspection and maintenance of all drainage facilities and erosion and sediment control structures to ensure proper and efficient operation at all times and particularly following rainstorms.					
S10	E15	Provision of oil interceptors in the drainage system downstream of any oil/fuel pollution sources.					
Specific N	Iitigation 1	Measures:		I	1	ı	
S10	E17	Survey and transplantation plant species of conservation concern before site clearance, and 2 years of monitoring after transplantation. During the latest field survey in January 2024 and the Transplantation and Management Plan, only three groups of Nepenthes mirabilis (Pitcher Plant) were found and feasible to be transplanted.	To minimise loss of plant species of conservation concern	Contractor	Within and construction site	Before commencement of construction phase	N/A
S10	E18	0.60 ha of woodland compensatory planting after restoration phase. 10-year ecological monitoring of compensatory woodland planting during the after-care phases	To mitigate loss of woodland habitat	Contractor	Entire construction site	Restoration and Aftercare phase	N/A
S10	E20	Survey and translocation of the three fish species of conservation interest before site clearance, including <i>Squaliobarbus curriculus</i> , <i>Osteochilus vittatus</i> and <i>Kuhlia marginata</i>	To provide precautionary measure for fish species of conservation concern	Contractor	Within and near Construction site	Before commencement of construction phase	
S10	E21	Set up water quality monitoring station at Tai Shui Hang Stream	To provide precautionary measure for fish species of conservation concern	Contractor	Tai Shui Hang Stream	Before commencement of construction phase	

Appendix B9 – Pulverized Fuel Ash Impact

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Recommended Measures &	Who to Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
Pulverize		Impact peration Phases					
S11.5	PF1	Recommended measures/ good practices are to be considered	To control radon health risk	Contractor	Entire WENT Landfill Extension site	and Operation	ProPECC Note PN 1/99 Control of Radon Concentration in New Buildings



Appendix N

Investigation Report



(Not Used)



Appendix O

Environmental Review Report for Handling of Construction Materials



Environmental Protection Department

2nd floor, West Wing

Island West Transfer Station

88 Victoria Road

Kennedy Town

Hong Kong

Your reference:

Our reference:

HKEPD259/50/110553

Date:

3 June 2025

Attention: Ms Kins Lo

BY EMAIL & POST (email: wklo@epd.gov.hk)

Dear Sirs

Quotation Ref. 23-02230 Provision of Independent Environmental Checker Consultancy Services for West New Territories Landfill Extension Environmental Review Report for Handling of Construction Materials (Version 3)

We refer to emails of 30 May and 3 June 2025 from Hong Kong Resources Recovery Park attaching the report of the captioned.

We have no comment and hereby verify the captioned report in accordance with Clause 1.9 of the Environmental Permit (EP No.: EP-393/2010/A) and Further Environmental Permit (FEP No. FEP-01/393/2010/A).

Should you have any queries, please do not hesitate to contact the undersigned or our Mr Ricky Lau at 2618 2831.

Yours faithfully

ANEWR CONSULTING LIMITED

James Choi

Independent Environmental Checker

CPSJ/LCCR/thy

Email: info@anewr.com Web: www.anewr.com





Our Ref: TCS01325/23/300/L0124

Hong Kong Resources Recovery Park

29/F China Overseas Building, 139 Hennessy Road, Hong Kong

Attn: Mr. Kenneth Lau

3 June 2025 By email

Dear Sir,

Contract No. EP/SP/186/21 Re:

West New Territories Landfill Extension (WENTX)

ETL's Certification letter for Environmental Review Report for handling of construction materials

With reference to the Environmental Review Report for handling of construction materials dated 19 May 2025, we have no comments on this submission and hereby certify the captioned report in accordance with 1.9 of Environmental Permit EP-393/2010/A and Further Environmental Permit FEP-01/393/2010/A.

Should you have any queries or require further information, please feel free to the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours sincerely, For and on Behalf of

Action-United Environmental Services & Consulting

Tam Tak Wing

Environmental Team Leader

cc

ANewR (IEC)

Mr. James Choi

By e-mail





JOB NO.: TCS01325/23

CONTRACT NO. EP/SP/186/21

WEST NEW TERRITORIES LANDFILL EXTENSION

ENVIRONMENTAL REVIEW REPORT FOR HANDLING OF CONSTRUCTION MATERIALS

PREPARED FOR

HONG KONG RESOURCES RECOVERY PARK

Date	Reference No.	Certified By
19 May 2025	TCS01325/23/600/R0091v3	Tam Tak Wing (Environmental Team Leader)

Version	Date	Remarks
1	6 February 2025	First Submission
2	3 March 2025	Amended according to comments on 15 and 18 February 2025
3	19 May 2025	Amended according to comments on EPD's comment



TABLE OF CONTENTS

1	INTRODU	JCTION	1
	1.1	BACKGROUND	1
	1.2	PURPOSE AND SCOPE OF THE ENVIRONMENTAL REVIEW REPORT (ERR)	1
	1.3	STRUCTURE OF REPORT	2
2	DESCRIP	TION OF THE PROPOSED MOBILE CRUSHING PLANT	3
	2.1	GENERAL	3
3	REIVEW	ON AIR QUALITY IMPACT	4
	3.1	GENERAL	4
	3.2	IDENTIFICATION OF POLLUTION SOURCES	4
	3.3	STUDY AREA AND AIR SENSITIVE RECEIVERS	5
	3.4	AIR QUALITY IMPACT ASSESSMENT	5
4	REIVEW	ON NOISE IMPACT	8
	4.1	GENERAL	8
	4.2	IDENTIFICATION OF POLLUTION SOURCES	8
	4.3	STUDY AREA AND NOISE SENSITIVE RECEIVERS	8
	4.4	NOISE IMPACT ASSESSMENT	8
5	REIVEW	ON WATER QUALITY IMPACT	9
	5.1	GENERAL	9
	5.2	IDENTIFICATION OF POLLUTION SOURCES	9
6	REIVEW	ON OTHER ENVIRONMETNAL IMPACT	10
	6.1	WASTE MANAGEMENT	10
	6.2	LANDFILL GAS HAZARD	10
	6.3	OTHER ASPECT	10
7	CONCLU	SION	11

LIST OF TABLES

TABLE 3-1	REPRESENTATIVE ASRs WITHIN 500M FROM THE BOUNDARY OF THE PROPOSED
	WORK

TABLE 3-2 SUMMARY OF CRUSHING PLANT DESIGNS

LIST OF APPENDICES

APPENDIX A I	LOCATION AND GENERAL LAYOUT OF THE PROPOSED MOBILE CRUSHING PLANT
APPENDIX A2	LOCATION PLAN OF CRUSHING PLANTS FROM THE \overline{VEP} Supporting document
APPENDIX B	LOCATION OF REPRESENTATIVE AIR SENSITIVE RECEIVERS



1 INTRODUCTION

1.1 BACKGROUND

- 1.1.1 The West New Territories Landfill Extension (WENTX) is classified as a Designated Project (DP) under Schedule 2, Part I of the Environmental Impact Assessment Ordinance (EIAO) (Cap. 499). The Environmental Impact Assessment (EIA) Report (AEIAR-147/2009) of WENTX was approved in November 2009 and the respective Environmental Permit no. EP-393/2010 was granted in June 2010.
- 1.1.2 In consideration of the interfacing projects, commitments, and neighbourhood enhancement initiatives, a revised reference design and implementation program for WENTX (hereafter referred to as the Enhanced Scheme) has been proposed. Under the Enhanced Scheme, the boundary of WENTX has been reduced, and the waste filling area and landfill capacity has been updated to 94 ha and 76 Mm³ respectively. The Variation of Environmental Permit (VEP) (application number VEP-617/2022) was applied by the project proponent, and EP-393/2010/A was subsequently issued by Environmental Protection Department (EPD) on 29 July 2022.
- 1.1.3 In August 2023, Hong Kong Resources Recovery Park (hereinafter named "HKRRP") was awarded the Design, Build and Operate (DBO) Contract of WENTX (hereinafter named "the Project"). Further Environmental Permit (FEP-01/393/2010/A) was granted by HKRRP from EPD on 6 October 2023.
- 1.1.4 According to the Supporting Document for Variation of Environmental Permit (hereinafter named "VEP document") and the desktop review for the WENTX reference design in 2022, there will be three sets of crushing plant at Eastern Platform and two sets of crushing plant on the newly formed land at Tsang Kok Stream outfall area for rock crushing and processing of the blasted rock, with the maximum total quantity material processed at 60,000 tonnes per day. Nevertheless, to support the current site formation works programme, a temporary rock crushing plant at West Ash Lagoon (refer as "Portions F1 and F2" thereby), with 4 sets of crushing plants and the maximum total quantity material processed at 12,000 tonnes per day.
- 1.1.5 In comparison to the original plan, the scale of crushing plant at Portions F1 and F2 is smaller in terms of the number of sets and handling rate. As a result, the dust and air quality impacts are expected to be diminished and are not anticipated to be significant, consistent with the findings of the VEP document.
- 1.1.6 The proposed operation period of the proposed crushing plant is targeted to commence in June 2025. As the processing capacity of the proposed mobile rock crushing plant exceeds 5,000 tonnes per annum, an application for a specified process license (SP License) has been submitted by the Contractor under the Air Pollution Control Ordinance (APCO) for this Project.
- 1.1.7 The proposed work site is delineated in Appendix A1, with its boundary more than 2,000 m from the nearest boundary of an existing or planned residential area, more than 250m from the nearest boundary of an existing place of worship, and no planning educational institution or health care institution within 200m of the work boundary. The proposed site will be utilized solely as a work site for handling the construction materials (i.e. rocks) related to the WENTX project.

1.2 PURPOSE AND SCOPE OF THE ENVIRONMENTAL REVIEW REPORT (ERR)

1.2.1 The purpose of this ERR is prepared to identify and assess the potential environmental impact during the construction and operation of the crushing plants in the proposed site.



1.3 STRUCTURE OF REPORT

- 1.3.1 Apart from the introductory section, there will be other sections in this Report as follows:
 - Section 2 Description of the proposed Mobile Crushing Plant;
 - Section 3 Review on Air Quality Impacts;
 - Section 4 Review on Noise Impacts;
 - Section 5 Review on Water Quality Impacts;
 - Section 6 Review on Other Environmental Impact;
 - Section 7 Conclusion



2 DESCRIPTION OF THE PROPOSED MOBILE CRUSHING PLANT

2.1 GENERAL

- 2.1.1 To support the current site formation works programme, a temporary rock crushing plant is proposed at Portion F1 and F2, with an operation period starting from June 2025. The site will be used for handling of construction materials after completion of the decommissioning works in accordance with the EP no. EP-652/2024. The proposed site will be utilized solely as a work site for handling the construction materials (i.e. rocks) related to the WENTX project.
- 2.1.2 The proposed work site is delineated at Portions F1 and F2 as shown in Appendix A1, with its boundary more than 2,000 m from the nearest boundary of an existing or planned residential area, more than 250m from the nearest boundary of an existing place of worship, and no planning educational institution or health care institution within 200m of the work boundary. The location and general layout of the proposed mobile crushing plant are shown in *Appendix A1*, while the location plan of crushing plants from the VEP supporting document is shown in *Appendix A2*.
- 2.1.3 The proposed mobile crushing plant will comprise of 4 nos. of production line, each with a design capacity of 300 tonnes per hour for operation time of 10 hours per day, aiming to treat 1,200 tonnes of rock per hour. As the processing capacity of the proposed mobile rock crushing plant exceeds 5,000 tonnes per annum, application for a specified process license (SP License) under the Air Pollution Control Ordinance (APCO) is required for this Project.
- 2.1.4 The following is the process flow of the mobile rock crushing plant.
 - a) Rocks will be transported via haul road to the mobile rock crushing plant;
 - b) The rocks will be fed into the primary crusher;
 - c) The crushed rock will then be delivered to the secondary and tertiary crushers, as well as the screener, either by gravity or via conveyor belts.
 - d) Throughout this crushing process, various batches of aggregate of different sizes will be produced.
 - e) The aggregates will be temporarily stored on-site before being exported.
 - f) Off-site transportation of materials from the rock crushing plants by sea (as far as possible).



3 REIVEW ON AIR QUALITY IMPACT

3.1 GENERAL

- 3.1.1 This section reviews and addresses potential air quality impact induced from the proposed crushing plants.
- 3.1.2 In 2022, an assessment was conducted to support the VEP application for the Enhanced Scheme of WENTX. The potential dust and air quality impacts during the construction, operational, restoration and aftercare phases of the proposed WENTX have been assessed and concluded that no adverse dust and air quality impacts due to the construction, operational, restoration and aftercare of the proposed WENTX is anticipated. The original designed crushing plants at Eastern Platform and on the newly formed land at Tsang Kok Stream outfall area has been taken account in the assessment in 2022.
- 3.1.3 In addition, an Air Pollution Control Plan for Mobile Crushing Plant (APCP), including an air quality impact assessment of the proposed mobile crushing plant using AERMOD Model has been conducted. The modelling results indicate that the predicted concentrations from all identified emission points comply with their respective statutory limits. The operation of the mobile crushing plant is unlikely to cause any significant air quality nuisance to the nearby air sensitive receivers.

3.2 IDENTIFICATION OF POLLUTION SOURCES

Construction Phase

3.2.1 During the setup of the mobile crushing plant, general construction activities will include site formation, rock fill for haul road, construction of u-channels and concreting. The duration of setting up the mobile crushing plant is relatively short-term. As a result, the impact of construction dust impact is considered to be minor. With the implementation of adequate dust suppression measures as stipulated under Air Pollution Control (Construction Dust) Regulation, Air Pollution Control (NRMMs) (Emission) Regulation and good site practices, potential construction dust impacts are not anticipated.

Operation Phase

- 3.2.2 Four production lines are proposed for operation of the crushing plant. Each production line will consist of primary, secondary and tertiary crushers, screens and conveyor systems. Particulate emissions are anticipated from the following rock processing activities during the operation of the mobile crushing plant:
 - a) Loading of raw materials to the crushers and screens;
 - b) Primary, secondary and tertiary crushing process;
 - c) First and second screening process;
 - d) Loading of rock material to conveyor;
 - e) Aggregate handling;
 - f) Wind erosion; and
 - g) Paved haul roads with vehicular movement.
- 3.2.3 Appropriate dust suppression measures, such as regular watering of rocks to be processed and aggregates, will be implemented to minimize potential dust emission arising from the handling and storage of the rocks and aggregates. The Best Practicable Mean for dust suppression and fugitive emission control has been incorporated into the design of the proposed crushing plant. Dust collectors, enclosures and water sprayers would be applied to control the particulate emission due to the rock processing activities.



3.2.4 Mobile crushers, screens, excavators, loaders, generators and conveyor system will be equipped with diesel-fuel power generator as their power supply. Consequently, gaseous emissions nitrogen oxides (NO_x), sulfur dioxide (SO₂) and particulates due to fuel combustion of these mobile machines are anticipated during the operation of the mobile crushing plant.

3.3 STUDY AREA AND AIR SENSITIVE RECEIVERS

3.3.1 The study area for the air quality assessment was defined as a distance of 500m from the boundary of the Project Site. The representative air sensitive receivers (ASRs) within the 500 m distance have been identified, listed in *Table 3-1* and is shown in *Appendix B*.

Table 3-1 Representative ASRs within 500m from the boundary of the proposed work

ASR	Description	Nature of Use	Distance Away from Project (m)
TTC1	Office of Tsang Tsui Columbarium	Government, Institution or Community	327

Note:

[1] Central air conditioning is provided for the office of Tsang Tsui Columbarium, and the fresh air intake is located at 4m above ground.

3.4 AIR QUALITY IMPACT ASSESSMENT

- 3.4.1 In 2022, an assessment was conducted to support the Enhanced Scheme of WENTX. The potential dust and air quality impacts during the construction, operational, restoration and aftercare phases of the proposed WENTX have been assessed.
- 3.4.2 Under the Enhanced Scheme in 2022, three sets of crushing plants will be located at the Eastern Platform, while two sets will be established at the newly formed land at the Tsang Kok Stream outfall area for rock crushing and processing of blasted rock. The maximum total quantity material processed will reach 60,000 tonnes per day, with each set of crushing plants having maximum handling rate of 1,000 tonnes per hour. The assessment concluded that no adverse dust and air quality impacts from the construction, operational, restoration and aftercare of the proposed WENTX are anticipated.
- 3.4.3 To support the current site formation works programme, a temporary rock crushing plant at Portions F1 and F2 is proposed. Operations at the Eastern Platform and Tsang Kok Stream Outfall area will be scheduled for a later stage. The proposed mobile rock crushing plant will comprise of four production lines, each with a design capacity of 300 tonnes per hour, operating for 10 hours per day. This setup aims to treat 1,200 tonnes of rock per hour.
- 3.4.4 In comparison to the original plan, the scale of crushing plant at Portions F1 and F2 is smaller in terms of the number of sets and handling rate. As a result, the dust and air quality impacts are expected to be diminished and are not anticipated to be significant, consistent with the findings of the VEP document. **Table 3-2** summarizes the crushing plant designs for the project.

Table 3-2 Summary of Crushing Plant Designs

	Rock crushing at Eastern Platform	Rock crushing at Tsang Kok Stream Outfall area	Proposed mobile crushing plant at Portion F1 and F2
Set of Crushing Plants	3	2	4
Assessment	Assessed in 2022	Assessed in 2022	Assessed APCP
Findings	No adverse dust and	No adverse dust and air	Dust and air quality impacts



Rock crushing at Eastern Platform	Rock crushing at Tsang Kok Stream Outfall area	Proposed mobile crushing plant at Portion F1 and F2
air quality impacts	quality impacts	are anticipated to be
		"better" than that as assumed in the VEP
		supporting document

- 3.4.5 Given that the processing capacity of the proposed mobile rock crushing plant exceeds 5,000 tonnes per annum. An application for a specified process license (SP License) has been submitted under the Air Pollution Control Ordinance (APCO) for this Project. To support this application, an Air Pollution Control Plan for the Mobile Crushing Plant (APCP) has been developed, which includes an air quality impact assessment utilizing the AERMOD model.
- 3.4.6 The modelling results indicate that the predicted concentrations from all identified emission points comply with their respective statutory limits. The operation of the mobile crushing plant is unlikely to cause any significant air quality nuisance to the nearby air sensitive receivers. The relevant air quality impact assessment is included in SP licence application.

Off-site transportation impact

- 3.4.7 According to the VEP document, processed materials from the rock crushing plants at the Eastern Platform and Tsang Kok Stream Outfall area will be exported off-site mainly by using enclosed conveyor belt system and transported to the marine barging points. In the temporary plan, blasted materials will be transported from WENTX to the proposed crushing plant by trucks via haul road. Then, same as the VEP document, the processed materials from the rock crushing plants will be exported off-site mainly by the marine barging point.
- 3.4.8 In this context, there is no change in the transport of the processed materials from the rock crushing plants (i.e. mainly by sea). Hence, there is no change and there is minimal impact on dust levels and overall air quality. This assessment supports the conclusion that the transportation activities associated with the project will not significantly contribute to air pollution in the area.
- 3.4.9 To conclude, with respect to the scale of the crushing plant operation, the potential air quality impact is considered insignificant. With the implementation of good site practices and appropriate mitigation measures, it is anticipated there will be no adverse residual air quality impact during the construction and operation stages of the proposed site.

3.5 MONITORING AND MITIGATION MEASURES

Dust Monitoring

- 3.5.1 The air quality monitoring station at the representative ASR (i.e., the Office of Tsang Tsui Columbarium) is one of the required air quality monitoring locations under WENTX (i.e., AM(D)7a). The existing EM&A program in the approved EM&A Manual is considered effective in ensuring the overall environmental performance of WENTX.
- 3.5.2 The operation of the crushing plants would also be monitored in accordance with the separate APCO SP licence requirement.

Mitigation Measures



- 3.5.3 The control measures for fugitive emission specified in the SP license shall be adhered to and implemented.
- 3.5.4 All practicable measures shall be taken to prevent or minimize the dust emission caused by vehicle movement. Vehicle cleaning facilities shall be provided at the site exit and used to clean leaving vehicle as specified in the SP license.



4 REIVEW ON NOISE IMPACT

4.1 GENERAL

4.1.1 This section reviews and addresses potential noise impact induced from the proposed crushing plants.

4.2 IDENTIFICATION OF POLLUTION SOURCES

Mobile Plant Operation

- 4.2.1 Construction noise is anticipated from the following rock processing activities during the operation of the mobile crushing plant:
 - a) Loading of raw materials to the crushers and screens;
 - b) Primary, secondary and tertiary crushing process;
 - c) First and second screening process;
 - d) Loading of rock material to conveyor;
 - e) Aggregate handling; and
 - f) Paved haul roads with vehicular movement.

4.3 STUDY AREA AND NOISE SENSITIVE RECEIVERS

4.3.1 The study area for noise impact assessment was defined as a distance of 300m away from the boundary of the Project Site. The nearest noise sensitive receiver (NSR) is located over 300m from the proposed site.

4.4 Noise Impact Assessment

- 4.4.1 Given that no identified NSRs are located within the 300m study area for noise, it is not anticipated that the proposed site will generate any noise nuisance.
- 4.4.2 No construction work during nighttime and evening hours is anticipated. A Construction Noise Permit will be required under the Noise Control Ordinance (NCO) for any works carried out during restricted hours, that is between 1900 0700 or at any time on a general holiday (including Sunday).
- 4.4.3 With the implementation of the mitigation measures and best practical means to minimize construction noise from all the concurrent projects, cumulative noise impact during operation of the proposed crushing plant is not expected.



5 REIVEW ON WATER QUALITY IMPACT

5.1 GENERAL

5.1.1 This section reviews and addresses potential water quality impact induced from the proposed crushing plants.

5.2 IDENTIFICATION OF POLLUTION SOURCES

- 5.2.1 The potential source of water quality impact during construction and operation of the crushing plant are expected from construction site runoff, temporary surface drainage system and accidental spillage of chemicals.
- 5.2.2 Construction site run-off includes runoff and erosion from site surfaces, earthworking areas and stockpiles. In addition, wash water from dust suppression sprays during construction work, vehicular movement along haul road and wheel washing facilities, as well as fuel, oil, solvents and lubricants from maintenance of construction machinery and equipment also contribute to the pollutant levels of the construction runoff.
- 5.2.3 Construction site runoff generated at the project site may increase the sediment loads and concentrations of suspended solids. However, with the proper implementation of the mitigation measures to control construction site runoff, specifically by covering open stockpiles of construction materials and exposed soil / earth surfaces with tarpaulin or similar fabric during rainstorms to prevent the washing away of construction materials, adverse water quality impact would not be anticipated.
- 5.2.4 A temporary surface drainage system will be provided at the project site to divert the construction site runoff to silt removal facilities. The runoff will be treated on-site to meet the effluent discharge standards as stipulated in the Technical Memorandum on Standards for Effluents discharged into Drainage and Sewerage Systems, Inland and Coastal Waters (TM-DSS) for Deep Bay WCZ prior to discharge. The Contractor is required to apply to EPD for a discharge license for discharge of effluent from construction site under the WPCO.
- 5.2.5 With the implementation of good site mitigation measures to control runoff from working areas, as outlined in ProPECC PN 2/23, and with the provision of sediment removal facilities, no adverse water quality impacts from site runoff are anticipated to occur in drainage channels and surrounding waterbodies.
- 5.2.6 The Contractor must register as a chemical waste producer if chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes. Any service shop and maintenance facilities should be located on hardstanding within a bunded area and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges.



6 REIVEW ON OTHER ENVIRONMETNAL IMPACT

6.1 WASTE MANAGEMENT

- 6.1.1 The types of waste arising from the decommissioning phase of the Project would include Construction and Demolition (C&D) materials, chemical waste, general refuse and.
- 6.1.2 C&D materials arising from the construction works will be reused by the project as far as practicable. Temporary stockpiling areas will also be provided to facilitate on-site reuse of inert C&D materials.
- 6.1.3 Small amount of chemical waste is expected to be generated from the maintenance of construction plants /equipment, and it should be collected by licensed chemical waste collectors. All possible opportunities should be taken to reuse and recycle the materials. Provided the chemical wastes are handled and disposed of in accordance with the mitigation and control requirements, adverse environmental impacts would not be anticipated.
- 6.1.4 General refuse comprising of food scraps, wastepaper, empty containers, etc. are expected to be generated from construction workers working on-site. Considering the small scale of the construction work for crushing plant, minimal construction waste is expected. General refuse will be generated by the workforce, however, due to the small size of workforce, only a minimal amount of general refuse is anticipated. As such, adverse environmental impacts arising from the storage, handling, and transportation of general refuse would not be anticipated.

6.2 LANDFILL GAS HAZARD

6.2.1 The Project site is located outside the 250m consultation zone of the existing WENT Landfill and the WENTX. Landfill gas hazard associated with this Project is not anticipated.

6.3 OTHER ASPECT

- 6.3.1 It should be noted that the site has been taking appropriate environmental precautionary measures since mid-December 2023, including covering the PFA surface with fill materials, to prevent the PFA deposited in the west ash lagoon from causing potential environmental impacts.
- 6.3.2 The site will be used for handling of construction materials after completion of the decommissioning works in accordance with the EP no. EP-652/2024. In case of any tree removal required, it shall be mitigated by tree transplanting / compensatory tree planting in accordance with DEVB TCW No. 4/2020.



7 CONCLUSION

- 7.1.1 To support the current site formation works programme, a temporary rock crushing plant at West Ash Lagoon (Portions F1 and F2) is proposed. The proposed operation period of the proposed crushing plant is targeted to commence in June 2025.
- 7.1.2 The proposed work site is delineated at Appendix A1, with its boundary more than 2,000 m from the nearest boundary of an existing or planned residential area, more than 250m from the nearest boundary of an existing place of worship, and no planning educational institution or health care institution within 200m of the work boundary. The proposed site will be utilized solely as a work site for handling the construction materials (i.e. rocks) related to the WENTX project.
- 7.1.3 The potential environmental impact for the proposed changes to the crushing plant operation has been reviewed. In comparison to the original plan, the scale of crushing plant at Portions F1 and F2 is smaller in terms of the number of sets and handling rate. As a result, the dust and air quality impacts are expected to be diminished and are not anticipated to be significant, consistent with the findings of the VEP document and APCP which support the application of the SP License.
- 7.1.4 The nearest NSR is located over 300m from the proposed crushing plant point. It is anticipated that the noise nuisance arising from the proposed site will be minor, given the limited number of Powered Mechanical Equipment (PME) in use at the project site, and that no identified NSRs are located within the 300m study area for noise.
- 7.1.5 With the implementation of good site practices and mitigation measures in place, there will be no adverse environmental impact on the water, waste, land contamination and other environmental impacts during the construction and operation stages of the proposed site. The environmental requirements set out in the approved EIA report for WENTX (including relevant documents submitted under the Ordinance for that EIA report) remains the same. It is recommended that weekly inspection should be undertaken by relevant parties, including ET and IEC, to ensure compliance with environmental standards and to monitor the effectiveness of the mitigation measures.



Appendix A1

Location and General Layout

of the proposed Mobile Crushing Plant






Appendix A2

Location Plan of Crushing Plants

from the VEP supporting document

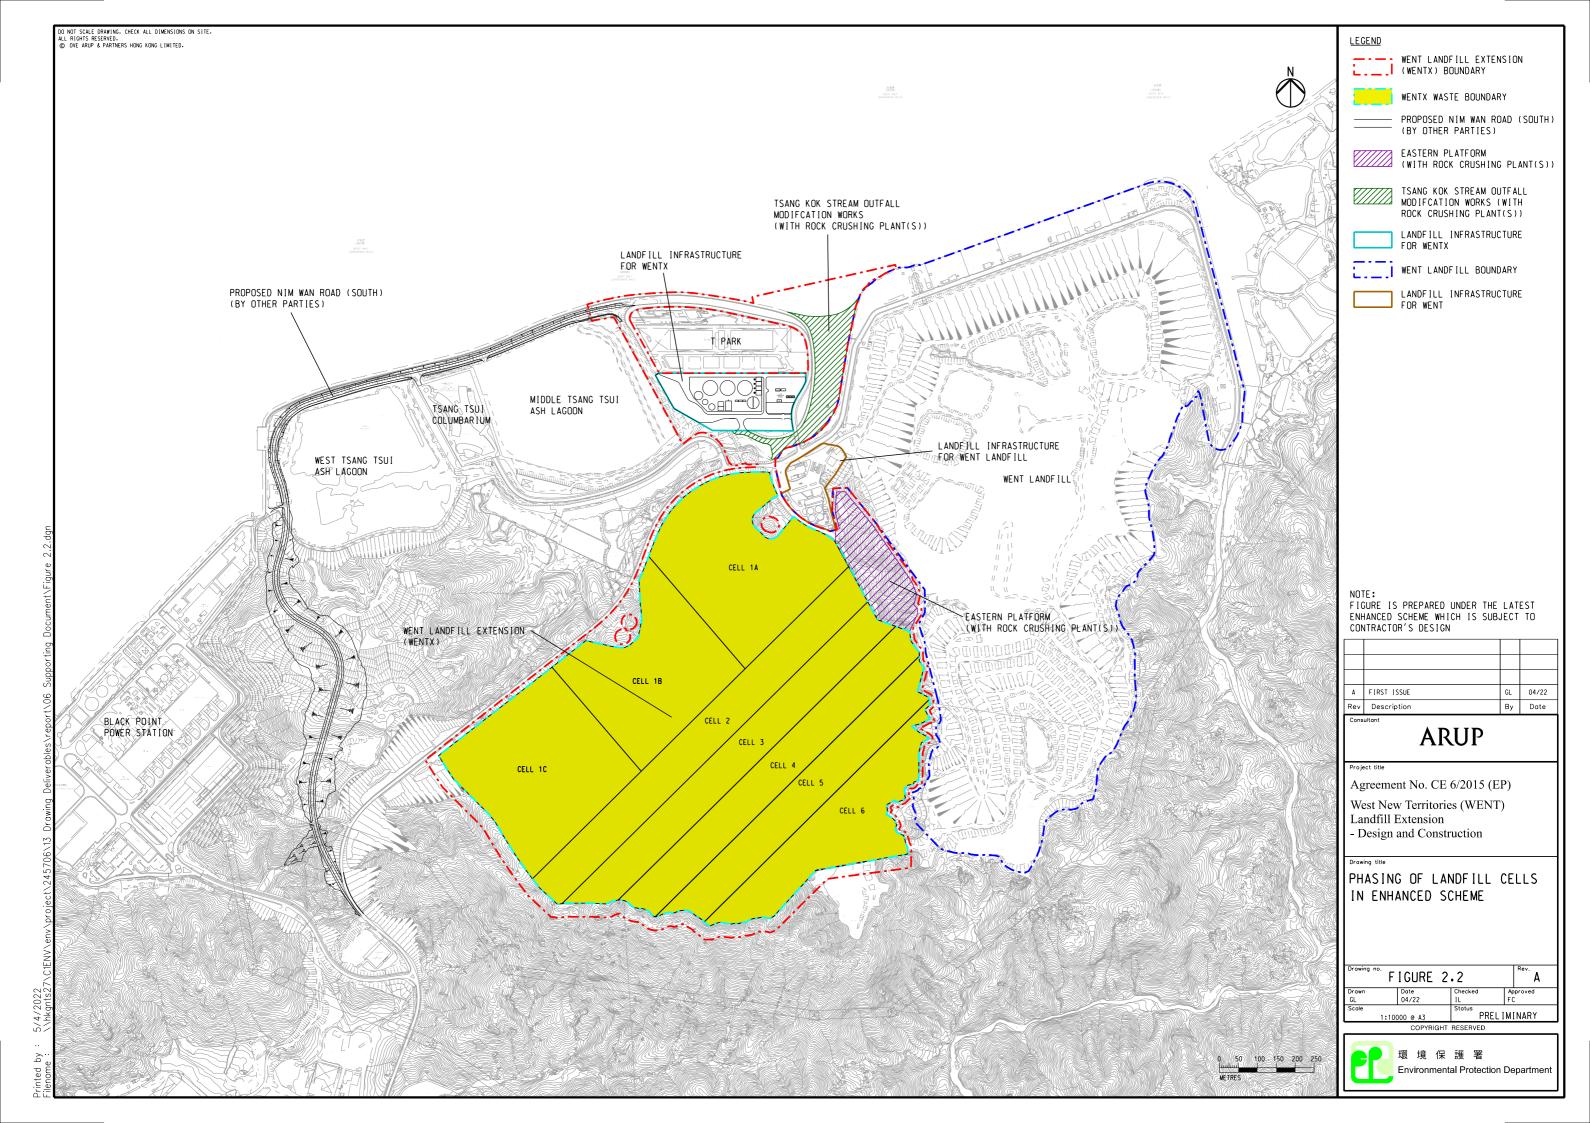




Appendix B

Location of Representative Air Sensitive Receivers




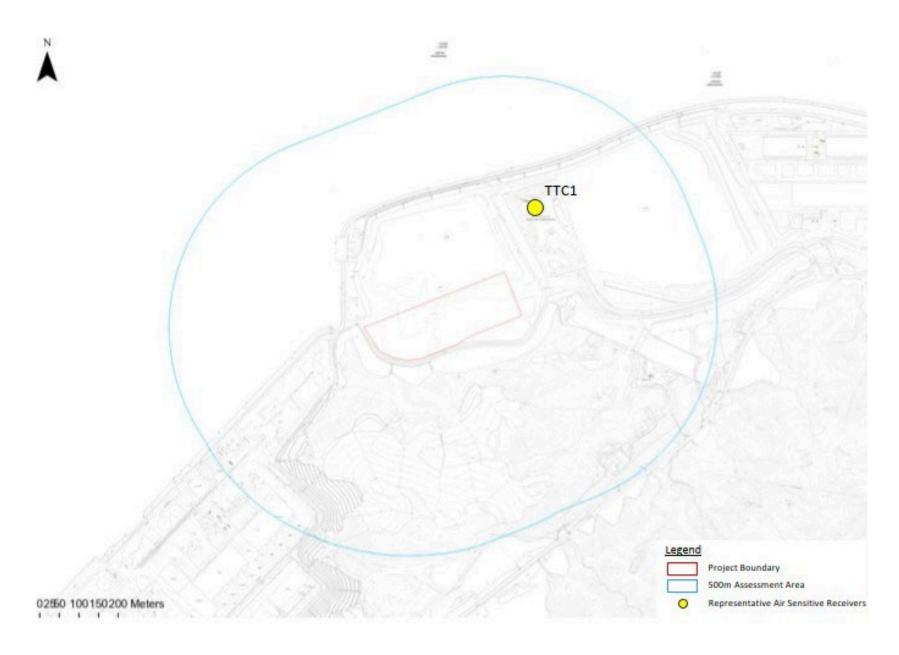




Appendix P

Habitat Map and Photo Record for 132kV Cable

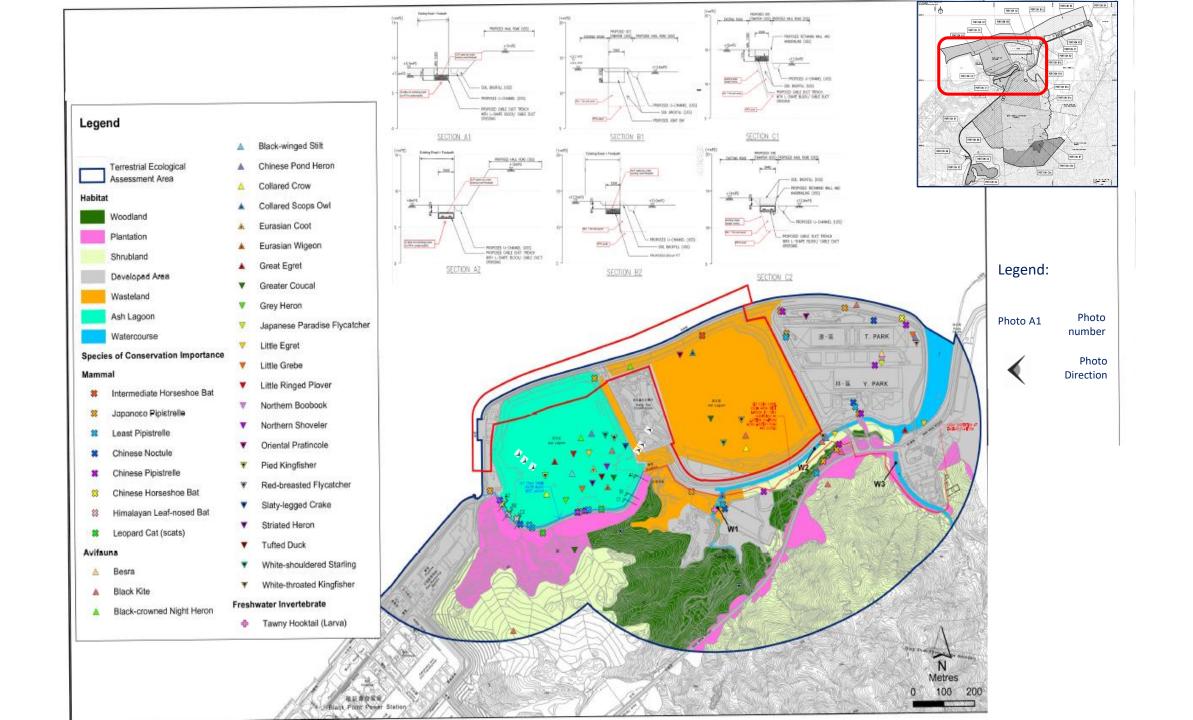

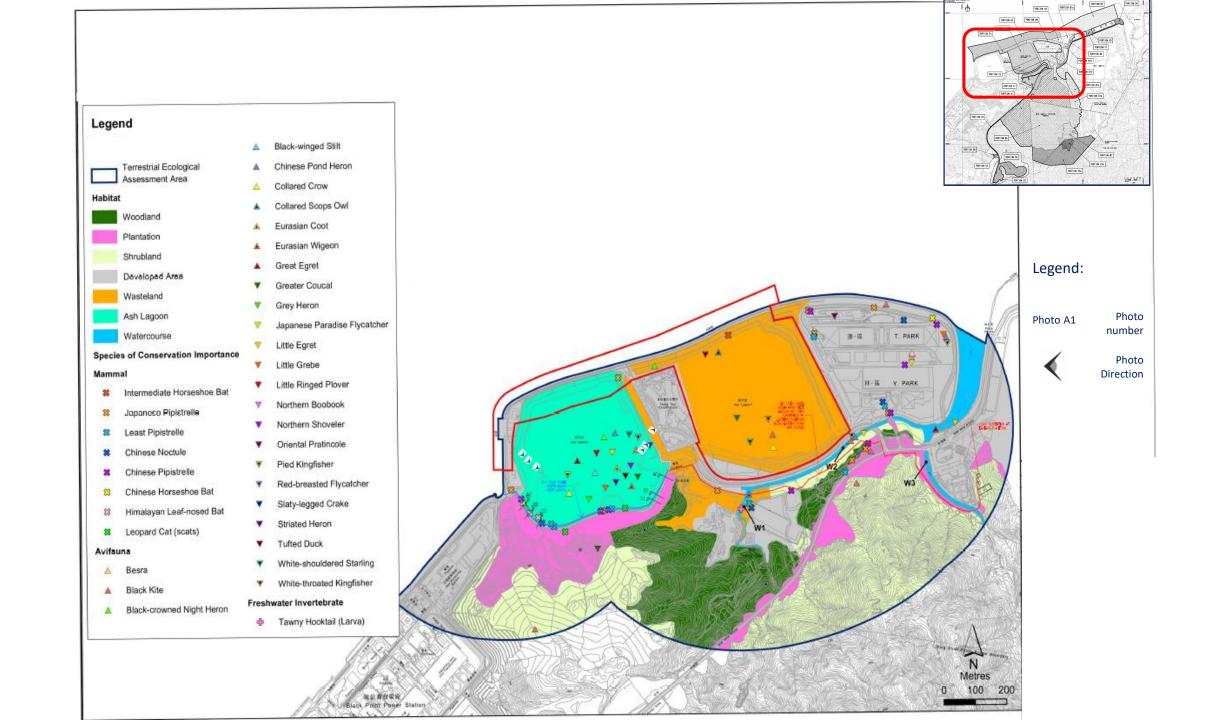

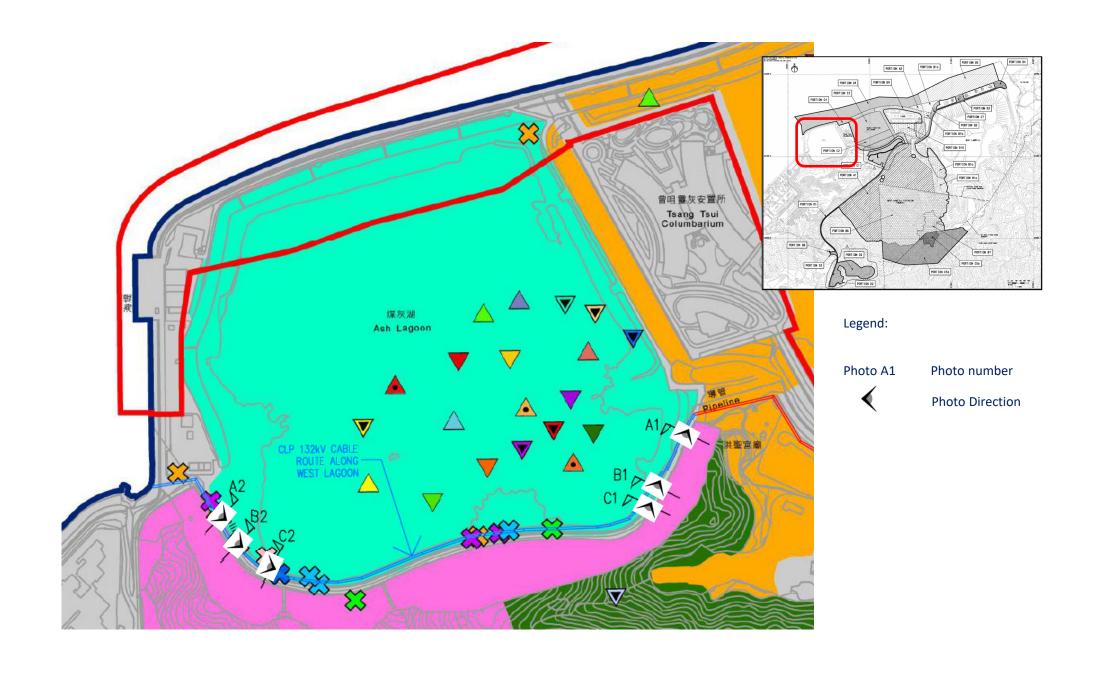




Photo A1



Photo C1



Photo B1



Photo A2



Photo B2



Photo C2

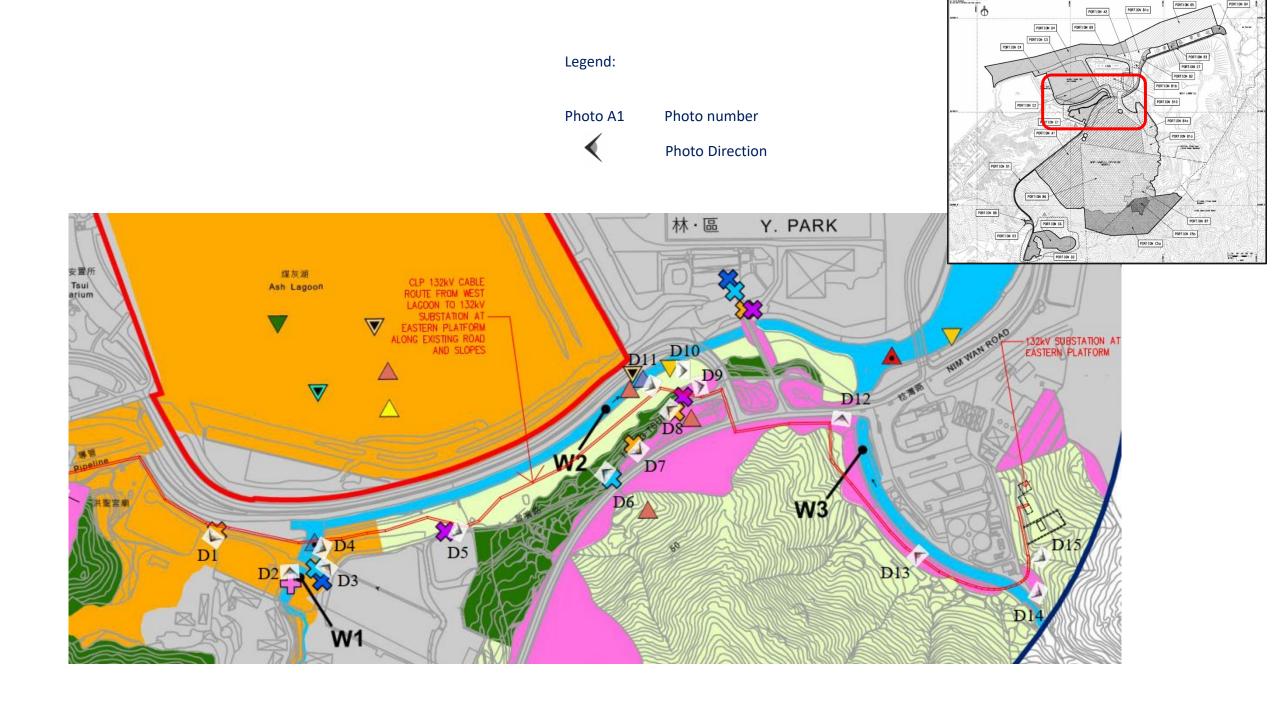




Photo D1



Photo D3



Photo D2



Photo D4



Photo D5



Photo D7



Photo D6



Photo D8



Photo D9



Photo D11



Photo D10



Photo D12



Photo D13



Photo D15



Photo D14