

JOB NO.: TCS01267/22

CONTRACT NO. EP/SP/186/21

WEST NEW TERRITORIES LANDFILL EXTENSION

**MONTHLY ENVIRONMENTAL MONITORING AND AUDIT
REPORT – JUNE 2026**

PREPARED FOR

HONG KONG RESOURCES RECOVERY PARK

Date	Reference No.	Prepared By	Certified By
10 July 2026	TCS01325/23/600/R0242v1	 Ben Tam (Senior Environmental Consultant)	 Tam Tak Wing (Environmental Team Leader)

Version	Date	Remarks
1	10 July 2026	First Submission

Our Ref: TCS01325/23/300/L0244

Hong Kong Resources Recovery Park
29/F China Overseas Building,
139 Hennessy Road, Hong Kong

Attn: Mr. Kenneth Lau

13 July 2026
By email

Dear Sir,

Re: Contract No. EP/SP/186/21
West New Territories Landfill (WENT) Extension
EP-393/2010/A and FEP-01/393/2010/A Condition 3.5
ETL's Certification Letter for
Monthly Environmental Monitoring and Audit Report – June 2026

With reference to the Monthly Environmental Monitoring and Audit Report – June 2026 (TCS01325/23/600/R0242v1), we hereby certify this submission in accordance with Condition 3.5 of EP-393/2010/A and FEP-01/393/2010/A.

Should you have any queries or require further information, please feel free to the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours sincerely,
For and on Behalf of
Action-United Environmental Services & Consulting



Tam Tak Wing
Environmental Team Leader



Environmental Protection Department
2nd floor, West Wing
Island West Transfer Station
88 Victoria Road
Kennedy Town
Hong Kong

Your reference:

Our reference: HKEPD259/50/111272

Date: 14 July 2026

Attention: Ms Kins Lo

BY EMAIL & POST
(email: wklo@epd.gov.hk)

Dear Sirs

Quotation Ref. 23-02230
Provision of Independent Environmental Checker Consultancy Services for
West New Territories Landfill Extension
Monthly Environmental Monitoring and Audit Report – June 2026

We refer to emails of 10, 13 and 14 July 2026 from Hong Kong Resources Recovery Park attaching the Monthly Environment Monitoring and Audit Report – June 2026 of the captioned.

We have no comment and hereby verify the captioned report in accordance with Clause 3.5 of the Environmental Permit (EP No.: EP-393/2010/A) and Further Environmental Permit (FEP No. FEP-01/393/2010/A).

Should you have any queries, please do not hesitate to contact the undersigned or our Mr Ricky Lau at 2618 2831.

Yours faithfully
ANewR CONSULTING LIMITED

James Choi
Independent Environmental Checker

CPSJ/LCCR/phwk

EXECUTIVE SUMMARY

INTRODUCTION

- ES.01 In August 2023, Hong Kong Resources Recovery Park (hereinafter named “HKRRP” or “the Contractor”) was awarded the Design, Build and Operate (DBO) Contract of Contract No. EP/SP/186/21 West New Territories Landfill Extension (hereinafter named “the Project”). Further Environmental Permit no. FEP-01/393/2010/A (hereinafter named “the EP”) was granted to HKRRP from Environmental Protection Department (EPD) on 6 October 2023.
- ES.02 Action-United Environmental Services & Consulting (hereinafter called “AUES”) was appointed by HKRRP as the Environmental Team (the “ET”) to implement environmental monitoring and auditing (EM&A) programme for the initial phase of the Project.
- ES.03 This is the 27th Monthly EM&A Report presenting the monitoring results and inspection findings for the Project for the period from 1st to 30th June 2026 (hereinafter called ‘the Reporting Period’).

ENVIRONMENTAL MONITORING AND AUDIT ACTIVITIES

- ES.04 Environmental monitoring activities under the EM&A programme of the Project in the Reporting Period are summarized in the following table.

Environmental Aspect	Monitoring Parameter	Monitoring Station/ Location	Date / Number of Monitoring
Air Quality	1-hour Total Suspended Particulates	AM(D)1, AM(D)2, AM(D)3, AM(D)5a, AM(D)6a, AM(D)7b	180 sessions
	24-hour Total Suspended Particulates		60 sessions
Noise	Leq(30min) Daytime	NM1	4 sessions
Water Quality (Surface water)	DO, Turbidity, pH, SS and chemical parameters etc.	WM1	1 session (5 th June 2026)
Site Inspection	Site audit for implementation of mitigation measures	Entire site	4 sessions

ACTION AND LIMIT (A/L) LEVELS EXCEEDANCE

- ES.05 In the Reporting Period no exceedances of air quality monitoring, construction noise (including Action Level for noise complaint) and surface water monitoring were recorded. The summary of exceedances recorded in the Reporting Period is shown table below.

Environmental Aspect	Monitoring Parameters	Action Level	Limit Level	Event & Action		
				NOE Issued	Investigation Result	Corrective Actions
Air Quality	1-hour TSP	0	0	0	--	--
	24-hour TSP	0	0	0	--	--
Construction Noise	Leq(30min) Daytime	0	0	0	--	--
Water Quality (Surface water)	DO	0	0	0	--	--
	Turbidity	0	0	0		
	pH	0	0	0		
	SS	0	0	0		

- ES.06 The LFG monitoring was conducted for excavation work in June 2026. No exceedance of Limit Levels of LFG was recorded during the Reporting Period. Moreover, baseline LFG monitoring at landfill gas well was carried out this reporting month.
- ES.07 For landscape and visual, implementation of mitigation measures during construction phase of the Project has been monitored through regular site inspection/ audit.
- ES.08 The Contractor was advised to implement the waste management plan and minimise the wastes generated through recycling or reusing. All mitigation measures stipulated in the updated EM&A Manual and waste management plans shall be fully implemented.

SITE INSPECTION

- ES.09 In the Reporting Period, weekly joint site inspection to evaluate the site environmental performance had been carried out by the representatives of the Service Manager (SM), ET and the Contractor. No non-compliance was noted during the site inspection. In addition, Independent Environmental Checker (IEC) carried out the joint site inspections on 11th June 2026.

ENVIRONMENTAL COMPLAINT

- ES.10 In the Reporting Period, one (1) environmental complaint was received by 1823 hotline on 5 June 2026 regarding dust from Nim Wan Road and dust suspension matter along Nim Wan Road on 1 June 2026. The investigation report (IR) has been submitted by ET and concluded that there is no evidence that the dust issue at Nim Wan Road was caused by the project, and that the complaint is therefore not Project related.

NOTIFICATION OF SUMMONS AND SUCCESSFUL PROSECUTIONS

- ES.11 In the Reporting Period, no environmental summons and prosecutions were recorded.

REPORTING CHANGE

- ES.12 There is no reporting change in the Reporting Period.

FUTURE KEY ISSUES

- ES.13 Water quality mitigation measures shall be fully implemented in accordance with the Implementation Schedule for Environmental Mitigation Measures of the updated EM&A Manual.
- ES.14 In addition, the Contractor should fully implement the recommended air quality mitigation measures to minimize the impact of construction dust as far as practicable.
- ES.15 Construction noise would be a key environmental issue during construction work of the Project. In accordance with the EP, a noise bund of 3.5m tall has been constructed along the north eastern seafront of the existing landfill as shown in Figure 2 of the EP prior to the commencement of construction. It is reminded that the noise bund shall be properly maintained during the construction, operation and restoration of the Project.

Table of Contents

1	INTRODUCTION	1
1.1	BACKGROUND	1
1.2	DESCRIPTION OF THE PROJECT	1
1.3	IMPLEMENTATION OF EM&A PROGRAMME	1
1.4	REPORT STRUCTURE	2
2	CONSTRUCTION PROGRESS AND PROJECT ORGANISATION	3
2.1	PROJECT ORGANISATION	3
2.2	CONSTRUCTION PROGRESS	4
2.3	SUMMARY OF ENVIRONMENTAL LICENSES AND PERMITS	5
3	AIR QUALITY MONITORING	7
3.1	MONITORING REQUIREMENTS	7
3.2	MONITORING PARAMETER, FREQUENCY AND DURATION	7
3.3	MONITORING LOCATIONS	7
3.4	MONITORING EQUIPMENT	9
3.5	MONITORING PROCEDURES	11
3.6	ACTION/LIMIT LEVELS FOR AIR QUALITY	11
3.7	AIR QUALITY MONITORING RESULTS	12
4	CONSTRUCTION NOISE MONITORING	13
4.1	MONITORING REQUIREMENTS	13
4.2	MONITORING PARAMETER, FREQUENCY AND DURATION	13
4.3	MONITORING LOCATIONS	13
4.4	MONITORING EQUIPMENT	13
4.5	MONITORING PROCEDURES	14
4.6	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE	14
4.7	NOISE MONITORING RESULTS	14
5	WATER QUALITY MONITORING	16
5.1	MONITORING REQUIREMENTS	16
5.2	MONITORING FREQUENCY AND DURATION	16
5.3	MONITORING LOCATIONS	16
5.4	ANALYSIS PARAMETERS	16
5.5	MONITORING EQUIPMENT	16
5.6	LABORATORY ANALYSIS	17
5.7	MONITORING PROCEDURES	18
5.8	DATA MANAGEMENT AND QUALITY ASSURANCE (QA)/QUALITY CONTROL (QC)	18
5.9	RESULTS OF SURFACE WATER QUALITY MONITORING	19
6	ECOLOGY MONITORING	20
6.1	REQUIREMENTS	20
6.2	ECOLOGICAL MITIGATION MEASURES	20
6.3	MONITORING AND AUDIT FOR ECOLOGY	20
7	LANDSCAPE AND VISUAL MONITORING	22
7.1	MONITORING REQUIREMENTS	22
7.2	MONITORING AND OBSERVATION	22
8	LANDFILL GAS MONITORING	23
8.1	REQUIREMENT	23
8.2	MONITORING PARAMETERS	23
8.3	MONITORING EQUIPMENT	23
8.4	MONITORING LOCATIONS	24
8.5	MONITORING FREQUENCY	24
8.6	A/L LEVELS AND EVENT ACTION PLAN	26
8.7	MONITORING RESULTS	26
9	WASTE MANAGEMENT	27

9.1	GENERAL WASTE MANAGEMENT	27
9.2	RECORDS OF WASTE QUANTITIES	27
10	SITE INSPECTION	28
10.1	REQUIREMENTS	28
10.2	FINDINGS / DEFICIENCIES DURING THE REPORTING PERIOD	28
11	ENVIRONMENTAL COMPLAINTS AND NON-COMPLIANCES	30
11.1	ENVIRONMENTAL COMPLAINTS, SUMMONS AND PROSECUTIONS	30
11.2	OTHER ENVIRONMENTAL NON-COMPLIANCES	30
12	IMPLEMENTATION STATUS OF MITIGATION MEASURES	31
12.1	GENERAL REQUIREMENTS	31
12.2	TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH	31
12.3	KEY ISSUES FOR THE COMING MONTH	32
13	CONCLUSIONS AND RECOMMENDATIONS	33
13.1	CONCLUSIONS	33
13.2	RECOMMENDATIONS	33

LIST OF TABLES

TABLE 2-1	STATUS OF ENVIRONMENTAL LICENSES AND PERMITS
TABLE 3-1	DUST MONITORING LOCATIONS
TABLE 3-2	1-HOUR TSP AIR QUALITY MONITORING EQUIPMENT
TABLE 3-3	24-HOUR TSP AIR QUALITY MONITORING EQUIPMENT
TABLE 3-4	ACTION AND LIMIT LEVELS FOR AIR QUALITY MONITORING
TABLE 3-5	SUMMARY OF 1-HOUR TSP MONITORING RESULTS
TABLE 3-6	SUMMARY OF 24-HOUR TSP MONITORING RESULTS
TABLE 4-1	CONSTRUCTION NOISE MONITORING STATION
TABLE 4-2	NOISE MONITORING EQUIPMENT
TABLE 4-3	ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE
TABLE 4-4	SUMMARY OF CONSTRUCTION NOISE MONITORING RESULTS
TABLE 5-1	SURFACE WATER MONITORING INSTRUMENT
TABLE 5-2	TEST METHOD AND REPORTING LIMIT OF CHEMICALS ANALYSIS
TABLE 5-3	ACTION AND LIMIT LEVELS FOR SURFACE WATER MONITORING DURING CONSTRUCTION PHASE
TABLE 8-1	LFG MONITORING EQUIPMENT
TABLE 8-2	A/L LEVELS AND EAP FOR LFG
TABLE 9-1	SUMMARY OF QUANTITIES OF INERT C&D MATERIALS
TABLE 9-2	SUMMARY OF QUANTITIES OF NON-INERT C&D WASTES
TABLE 10-1	SITE INSPECTION AND OBSERVATIONS
TABLE 11-1	STATISTICAL FOR ENVIRONMENTAL COMPLAINTS, SUMMONS AND PROSECUTIONS

LIST OF APPENDICES

APPENDIX A	LOCATION PLAN OF ENHANCED SCHEME OF WENTX LANDFILL EXTENSION
APPENDIX B	PROJECT ORGANIZATION AND THE KEY PERSONAL CONTACT
APPENDIX C	3-MONTH ROLLING CONSTRUCTION PROGRAMME
APPENDIX D	MONITORING LOCATIONS
APPENDIX E	CALIBRATION CERTIFICATES
	(1) AIR QUALITY MONITORING EQUIPMENT
	(2) NOISE MONITORING EQUIPMENT
	(3) WATER QUALITY MONITORING EQUIPMENT
	(4) LFG MONITORING EQUIPMENT
APPENDIX F	METEOROLOGICAL DATA
APPENDIX G	EVENT AND ACTION PLAN
APPENDIX H	MONITORING SCHEDULE
APPENDIX I	DETAILED MONITORING RESULTS
APPENDIX J	GRAPHICAL PLOTS FOR MONITORING RESULT
APPENDIX K	WASTE FLOW TABLE
APPENDIX L	CUMULATIVE ENVIRONMENTAL COMPLAINTS LOG
APPENDIX M	ENVIRONMENTAL MITIGATION IMPLEMENTATION SCHEDULE
APPENDIX N	INVESTIGATION REPORT
APPENDIX O	PHOTO RECORD OF TREE AT RECEPTOR SITE OF PORTION B4 AND 30M TREE BUFFER ZONE
APPENDIX P	PHOTO RECORD OF PITCHER PLANT TRANSPLANTATION
APPENDIX Q	ENVIRONMENTAL REVIEW REPORT FOR TRIAL OPERATION

1 INTRODUCTION

1.1 BACKGROUND

- 1.1.1 The West New Territories Landfill Extension (WENTX) is classified as a Designated Project (DP) under Schedule 2, Part I of the Environmental Impact Assessment Ordinance (EIAO) (Cap. 499). The Environmental Impact Assessment (EIA) Report (AEIAR-147/2009) of WENTX was approved in November 2009 and the respective Environmental Permit no. EP-393/2010 was granted in June 2010. For the WENTX development scheme adopted in the WENTX-EIA in 2009 (hereby referred to the Original Scheme), an area of about 188 hectares of land adjacent to the existing WENT landfill was considered that to be provided approximately 81 million m³ (Mm³) of additional landfill capacity.
- 1.1.2 In consideration of the interfacing projects, commitments and neighbourhood enhancement initiatives were proposed and in conjunction with the project, the reference design and implementation programme for the WENTX (hereby referred to the Enhanced Scheme) has been revised. Under the Enhanced Scheme, the boundary of WENTX has been reduced and the waste filling area and landfill capacity has been updated to 94 ha and 76 Mm³ respectively. Variation of Environmental Permit (application number VEP-617/2022) was applied by the project proponent and EP-393/2010/A was issued by Environmental Protection Department (EPD) on 29 July 2022 subsequently. The location plan of Enhanced Scheme of WENTX Landfill Extension is shown on *Appendix A*.
- 1.1.3 In August 2023, Hong Kong Resources Recovery Park (hereinafter named “HKRRP” or “the Contractor”) was awarded the Design, Build and Operate (DBO) Contract of WENTX (hereinafter named “the Project”). Further Environmental Permit no. FEP-01/393/2010/A (hereinafter named “the EP”) was granted to HKRRP from EPD on 6 October 2023.

1.2 DESCRIPTION OF THE PROJECT

General Description of the Project

- 1.2.1 The development of the WENT Landfill Extension will involve the following works:
- Site formation and preparation;
 - Installation of landfill infrastructures including leachate treatment plant, landfill gas management plant, power generators, workshops and site offices;
 - Installation of liner system;
 - Installation of leachate collection, treatment and disposal facilities;
 - Installation of gas collection and utilization facilities;
 - Provision of utilities and drainage;
 - Landfill operation;
 - Restoration and aftercare in subsequent stages; and
 - Implementation of measures to mitigate environmental impact as well as environmental monitoring and audit.

1.3 IMPLEMENTATION OF EM&A PROGRAMME

- 1.3.1 Action-United Environmental Services & Consulting (hereinafter called “AUES”) was appointed by HKRRP as the Environmental Team (ET) to implement environmental monitoring and auditing (EM&A) programme for the initial phase of the Project.
- 1.3.2 In accordance with EP-393/2010/A and FEP-01/393/2010/A Condition 3.1, an updated EM&A Manual has been prepared to include the latest EM&A requirement in accordance with the information and recommendation described in the EIA Report and by taking into account any specific site conditions that may be changed before the construction of the Project. It

outlines the monitoring and audit programme for the Project for the construction phase and provided systematic procedures for monitoring, auditing and minimizing environmental impacts ensure compliance with the EIA recommendations.

- 1.3.3 Baseline monitoring for air quality and background noise were conducted from 3rd January 2024 to 31st March 2024 by the ET at all the designated or any alternative monitoring locations in accordance with the updated EM&A Manual. In addition, surface water quality baseline monitoring were conducted from 20th February to 2nd March 2024. During the monitoring period, no construction activities under the Project or other external influencing factors of significant concern were observed. Baseline Monitoring Report has been prepared to present the relevant baseline data and determine the set of Action and Limit Levels (A/L Levels) for the construction phase of the Project.
- 1.3.4 In view of commencement of construction work of Project on 3rd April 2024, the Construction Phase EM&A monitoring for relevant impact monitoring was commenced subsequently.
- 1.3.5 This is the **27th** Monthly EM&A Report, presenting the monitoring results and inspection findings for the Project, for the period from **1st to 30th June 2026** (hereinafter called ‘the Reporting Period’).

1.4 REPORT STRUCTURE

- 1.4.1 The Monthly EM&A Report is structured into the following sections:-

Section 1	<i>Introduction</i>
Section 2	<i>Project Organization and Construction Progress</i>
Section 3	<i>Air Quality Monitoring</i>
Section 4	<i>Construction Noise Monitoring</i>
Section 5	<i>Water Quality Monitoring</i>
Section 6	<i>Ecology Monitoring</i>
Section 7	<i>Landscape and Visual Monitoring</i>
Section 8	<i>Landfill Gas Monitoring</i>
Section 9	<i>Waste Management</i>
Section 10	<i>Site Inspections</i>
Section 11	<i>Environmental Complaints and Non-Compliances</i>
Section 12	<i>Implementation Status of Mitigation Measures</i>
Section 13	<i>Conclusions and Recommendations</i>

2 CONSTRUCTION PROGRESS AND PROJECT ORGANISATION

2.1 PROJECT ORGANISATION

- 2.1.1 The project organization and the key personal contact are shown in *Appendix B*, which consists of the Project Proponent (EPD / Environmental Infrastructure Division), Contractor, ET, Independent Environmental Checker (IEC), and Service Manager (SM) etc. It should be established to take the responsibilities for environmental protection for this landfill extension project. The IEC will be appointed by the Project Proponent to conduct independent auditing of the overall EM&A programme including environmental and operation monitoring, implementation of mitigation measures, EM&A submissions, and any other submissions required under the EP. The individual responsibilities are:

Environmental Protection Department (EPD)

EPD/ Environmental Infrastructure Division is the Project Proponent of the Project.

Contractor

- Employment of an ET to carry out environmental monitoring, laboratory analysis and reporting of environmental monitoring and audit;
- Submission of proposals of mitigation measures in case of exceedances of Action and Limit (A/L) Levels in accordance with the Event and Action Plan (EAP);
- Implementation of mitigation measures to reduce the impacts where A/L Levels are exceeded; and
- Adherence to the agreed procedures for carrying out complaint investigation.

ET

- Setting up of all the required environmental monitoring stations;
- Monitoring of various environmental parameters as required;
- Analysis of monitoring and audit data and review the success of EM&A programme to cost-effectively confirm the adequacy of mitigation measures implemented and the validity of the EIA predictions and to identify any adverse environmental impacts arising;
- Carrying out site inspections to investigate and audit the Contractor's site practices, equipment and work methodologies with respect to pollution control and environmental mitigation, and take proactive actions to resolve problems;
- Auditing and preparation of audit reports on environmental monitoring data and site conditions;
- Reporting of environmental monitoring and audit results to the IEC, Contractor, SM and Project Proponent or its delegated representative;
- Recommendation of suitable mitigation measures to the Contractor in case exceedance of A/L Levels in accordance with the EAP;
- Undertaking of regular on-site audits/ inspections and reporting to the Contractor and SM of any potential non-compliance; and
- Following up and closing out of non-compliance actions.

IEC

- Review of EM&A programme by the ET (at not less than monthly intervals);
- Auditing of monitoring activities and results (at not less than monthly intervals);
- Reporting of audit results to the SM and Project Proponent in parallel;
- Reviewing of EM&A reports (monthly, quarterly and annual summary reports) submitted by the ET;
- Reviewing of proposal of mitigation measures submitted by the Contractor in accordance with the EAP;
- Checking of mitigation measures recommended in the EIA Report and EM&A Manual, and ensuring they are properly implemented in timely manner when required; and

- Reporting of findings of site inspections and other environmental performance reviews to SM and Project Proponent.
- To check the records of disposal for the different types of C&D materials, including the DRS maintained by the Contractor during the monthly environmental auditing;
- To check the disposal records kept by the SM, especially the name of the designated public fill reception facilities, sorting facilities, outlying island transfer facilities, landfills and/or alternative disposal grounds, the time and date of disposal.

SM

- Verification and checking Contractor's activities and ensure that the requirements in the EM&A Manual are fully complied with;
- Informing Contractor when action is required to reduce impacts in accordance with the EAP; and
- Ensure compliance with the agreed EAP in case any exceedance.

2.1.2 Sufficient and suitably qualified professional and technical staff should be employed by the respective parties to ensure full compliance with their duties and responsibilities, as required under the EM&A programme for the duration of the Project.

2.2 CONSTRUCTION PROGRESS

2.2.1 The 3-month rolling construction programme of the Project are shown in *Appendix C*, and the major construction activities carried out in the Reporting Period are listed below:-

Eastern Platform – Site Formation

- Soft Excavation
- Rock Excavation
- 132kV Substation Construction
- Blasting
- Installation of Monitoring Wells
- Leachate Liner Installation

Landfill Waste Filling Area (Phase I) - Site Formation

- Soft Excavation
- Rock Excavation
- Blasting

Crusher and Conveyor Belt System

- Rock Crushing
- Plant Installation
- Piling Works

Rising Main and Fresh Watermain Along Nim Wan Road

- Pipe Laying Works
- Construction of Pump House

Reclamation and Box Culverts

- Reclamation in DCM Area
- Box Culvert Construction

Marine Works

- Temporary Drainage Diversion
- Maintenance Dredging Work

- Construction of Vertical Seawall

Major Buildings in B10 & B9 (Service Bldg, Filtration Bldg, Bioreactor Bldg)

- BS Works & E&M Installation
- CLP Transformer Installation
- Footing Excavation
- RC Works

Weighbridge Reprovision/Modification Works

- Drainage, Utilities and Roadwork

2.3 SUMMARY OF ENVIRONMENTAL LICENSES AND PERMITS

2.3.1 To implement the project works, summary of the relevant permits, licenses, and/or notifications on environmental protection are presented in **Table 2-1**.

Table 2-1 Status of Environmental Licenses and Permits

Item	Description	License/Permit Status		
		Ref. no.	Effective Date	Expiry Date
1	Environmental Permit	FEP-01/393/2010/A	6 Oct 2023	--
2	Waste Disposal Regulation - Billing Account for Disposal of Construction Waste	Account No. 7048594	22 Sep 2023	--
3	Chemical Waste Producer Registration	WPN: 5213-4361-1-H4441-01	18 Oct 2023	--
4	Water Pollution Control Ordinance - Discharge License	WT10002363-2023 (Portion C1)	6 May 2024	31 May 2029
		WT10002525-2023 (Portion B1a)	6 May 2024	31 May 2029
		WT00045324-2024 (Portion B2)	12 Dec 2024	31 Dec 2029
		WT00045991-2025 (Portion B10)	14 Mar 2025	31 Mar 2030
		WT00046816-2025 (Portion B9) (P)	12 Aug 2025	31 Aug 2030
		WT00047756-2025 (Portion B9) (TKS)	4 Feb 2026	28 Feb 2031
		WT00047259-2025 (Portion C7)	5 Nov 2025	30 Nov 2030
		WT00047257-2025 (Portion F)	5 Nov 2025	30 Nov 2030
5	Noise Control Ordinance – Construction Noise Permit	GW-RW0026-26 (Portion C1) (Expired)	14 Jan 2026	13 Jun 2026
		GW-RW0553-26 (Portion C1)	14 Jun 2026	13 Dec 2026
		GW-RW0252-26 (Portion B10)	27 Mar 2026	26 Sep 2026

Item	Description	License/Permit Status		
		Ref. no.	Effective Date	Expiry Date
		GW-RW0457-26 (Portion B1a)	15 May 2026	14 Nov 2026
		GW-RW0083-26 (Portion B2)	8 Feb 2026	7 Aug 2026
		GW- RW0086-26 (Portion B4)	8 Feb 2026	7 Aug 2026
		GW-RW0239-26 (Portion B9) (Superseded)	24 Mar 2026	23 Sep 2026
		GW-RW0520-26 (Portion B9)	1 Jun 2026	28 Nov 2026
		GW-RW0119-26 (Portion D1)	13 Feb 2026	12 Jul 2026
		GW-RW1288-25 (Portion F)	31 Dec 2025	30 Jun 2026
		GW-RW0318-26 (Portion G1)	13 Apr 2026	12 Oct 2026
		GW-RW0130-26 (Portion B5, D4)	17 Feb 2026	16 Jul 2026
		GW-RW0432-26 (Portion C7)	19 May 2026	18 Nov 2026
6	Licence for the Conduct of a Specified Process (SP License)	L-11-058(1) Mineral Works (Stone Crushing Plant)	29 Apr 2025	28 Apr 2030
7	Marine Dumping Permit	EP/MD/26-056 (Dredged Sediment Requiring Type 1 – Open Sea Disposal)	1 Feb 2026	31 Jul 2026
		EP/MD/27-002 (Dredged Sediment Requiring Type 2 – Confined Marine Disposal)	1 May 2026	31 July 2026

2.3.2 Before the official full WENTX landfill operation, the WENTX is scheduled to commence a trial operation in the 2nd half of 2026, including limited waste intake to ensure a smooth transition from the existing WENT Landfill to the WENTX. To identify and assess the potential environmental impact of the trial operation the Environmental Review Report (ERR) had been conducted and verified by IEC which concluded that no adverse environmental impact is anticipated. The ERR for trial operation of WENTX landfill is illustrated in *Appendix Q*.

3 AIR QUALITY MONITORING

3.1 MONITORING REQUIREMENTS

- 3.1.1 Monitoring of the Total Suspended Particulate (TSP) levels shall be carried out by the ET to ensure that any deteriorating air quality could be readily detected and timely action be taken to rectify the situation. 1-hour and 24-hour TSP levels should be measured to indicate the impacts of construction dust on air quality. The TSP levels shall be measured by following the standard high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, USA, Chapter 1 (Part 50), Appendix B. Upon approval by the IEC, 1-hour TSP levels can be measured by direct reading methods which are capable of producing comparable results as that by the high volume sampling method, to indicate short event impacts.
- 3.1.2 All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and other special phenomena and work progress of the concerned site etc. shall be recorded down in details.
- 3.1.3 The ET shall carry out impact monitoring during the course of the Works. In case of non-compliance with the dust criteria, more frequent monitoring exercise, as specified in the Action Plan, shall be conducted within 24 hours after the result is obtained. This additional monitoring shall be continued until the excessive dust emission or the deterioration in air quality is rectified.

3.2 MONITORING PARAMETER, FREQUENCY AND DURATION

- 3.2.1 In accordance with the EP requirement, for regular impact monitoring, the sampling frequency of at least twice in every six-days, shall be strictly observed at all the monitoring stations for 24-hr TSP monitoring. For 1-hr TSP monitoring, the sampling frequency of at least six times in every six-days should be undertaken when the highest dust impact occurs. The specific time to start and stop the 24-hr TSP monitoring shall be clearly defined for each location and be strictly followed by the Contractor.

3.3 MONITORING LOCATIONS

- 3.3.1 Five dust monitoring locations have been recommended in the approved Final EM&A Manual and two additional monitoring stations (AM(D)6 and AM(D)7) were suggested in VEP supporting document. Joint site visits by the Contractor and ET have been conducted at the recommended locations to verify their status and obtain agreement to install dust monitoring equipment for before the implementation of EM&A Programme.
- 3.3.2 When alternative monitoring locations are proposed, the following criteria, as far as practicable, should be followed:
- At the site boundary or such locations close to the major dust emission source;
 - Close to the sensitive receptors; and
 - Account for the prevailing meteorological conditions

Proposed Alternative Locations

AM(D)4

A formal email has been sent to Black Point Power Station on 27th December 2023 for access authorization to the premise in order to carry out dust monitoring. The corresponding team of Black Point Power Station replied that due to the safety and security reason, they rejected to provide access for dust monitoring activities in their premise. The only available location for monitoring is at the main access road of the premises, which is directly affected by traffic dust. It is unclear whether this location accurately represents the dust impact from either the traffic

or the WENTX site, therefore, this location is considered unsuitable.

After AM(D)4 (Black Point Power Station Office and Control Room) rejected the proposal of installing dust monitoring equipment within their premises, alternative locations were sought which included locations near the Lung Kwu Sheung Tan Village Supply Tank and Lung Kwu Sheung Tan Service Reservoir. Visits to the above two locations were made for 4 weeks after the rejection from Black Point Power Station on 18 January 2024. It was concluded that there was no site personnel permanently stationed at these two locations and these premises are probably visited by personnel on an ad-hoc basis. Furthermore, it was observed that these premises have no window and air conditioning equipped, no site personnel was on duty at the building during site visit. With the implementation of the dust suppression measures stipulated in Air Pollution Control (Construction Dust) Regulation, adverse air quality impact is not anticipated at these two locations, and there are no other ASRs on the west side of the Project site. Thus, it was concluded that no further alternative location can be considered.

AM(D)5

During baseline monitoring conducted at AM(D)5 on 27th Jan to 9th Feb 2024, it has been observed that 9 out of 14 monitoring days recorded 24-hour TSP levels exceeding the Limit Level (260µg/m³). Investigation was conducted to identify cause of high baseline 24-hour TSP result, and it is considered that the frequent passage of heavy vehicles, particularly on the unpaved access road to the nearby warehouses, was the main contributing factor to the elevated 24-hour TSP levels. As the baseline level for 24-hour TSP at AM(D)5 exceeded the limit level, and the exceedances were due to the local traffic. In accordance with the updated EM&A Manual, ET had conducted a second set of baseline monitoring at new location closer to the WENTX site, which demonstrate a more representative data on dust impact associated from WENTX (hereinafter named AM(D)5a) for the parameters of 1-hour and 24-hour TSP from 16th to 31st March 2024.

AM(D)6

Site visit and meeting with T · Park was held on 15th January 2024 and it is concluded and agreed that air quality monitoring equipment should be relocated to the rooftop of T · Park workshop instead of the T · Park office, which is the best available alternative monitoring location in the facility. The distance between T · Park office and workshop is approximately 100m. They are both located to the north of the site boundary and experiencing the same prevailing meteorological conditions.

AM(D)7

Site visit was conducted at the proposed designated location on 28th December 2023, and after discussion with the management representative of the premises, access authorization to carry out dust monitoring was rejected due to unsuitable conditions.

An alternative location has been sought based on the recommended criteria. It is proposed to relocate the monitoring location (north facing) to the site boundary of Middle Tsang Tsui Ash Lagoon and at the location avoid the emission from the premises (east facing). The proposed alternative monitoring location AM(D)7a is approximately 10 meters away from the designated location AM(D)7. Both locations are situated to the north-west of the site boundary and experiencing the same prevailing meteorological conditions. The southern boundary of the Tsang Tsui Columbarium site such as the entrance area has been explored subsequently, but it is not feasible without stable electricity.

Relocation Dust Monitoring Location AM(D)7a in 29 September 2025

The current dust monitoring location AM(D)7a is situated at the boundary of Middle Tsang Tsui Ash Lagoon, however, this site will be handed back in late 2025 under the contract for development by others. It is considered the current location is no longer suitable for impact monitoring due to it falls within the site boundary of others.

An alternative location has been sought and proposed in accordance with the Final EM&A Manual Section 3.1.4. After discussions with the Contractor, the proposed alternative location (hereinafter named “AM(D)7b”) will be the southwest of boundary of Tsang Tsui Columbarium. The details of the proposed location and justification are presented below.

The alternative location AM(D)7b is situated at the southwest of boundary of Tsang Tsui Columbarium, where close to the major dust emission source from the Project. Stable electricity supply could be provided by the Contractor. In addition, it is the closest available location to the existing Air Sensitive Receiver - Tsang Tsui Columbarium, (which was AM(D)7 but setting up monitoring equipment on its premises was rejected). Both AM(D)7a and AM(D)7b are located to the northwest of WENTX, and they are experiencing similar prevailing meteorological conditions.

Considering that both AM(D)7a and AM(D)7b are located to the northwest of WENTX and are experiencing similar prevailing meteorological conditions, baseline monitoring data, as well as the Action and Limit Level of AM(D)7a, could be adopted for AM(D)7b for consistency. Since the major construction activities of the project are underway and the baseline monitoring data of AM(D)7a is adopted, baseline monitoring for AM(D)7b will not be carried out.

Proposal for Alternative Dust Monitoring Location AM(D)7a was submitted to EPD and granted EPD’s approval in late September 2025.

The updated dust monitoring locations have been included in the updated EM&A Manual. The proposed dust monitoring locations for impact monitoring are shown in **Table 3-1** and illustrated in **Appendix D**.

Table 3-1 Dust Monitoring Locations

Station ID	ASR ID	Location	Land use
AM(D)1	A1-1	Ha Pak Nai	Residential
AM(D)2	A1-2	Ha Pak Nai	Residential
AM(D)3	A1-3	Ha Pak Nai	Residential
AM(D)5a	A4-1	Lung Kwu Sheung Tan	Place of Worship
AM(D)6a	A3-1	Rooftop of T·Park workshop	Office
AM(D)7b	A5-2	Site boundary of West Tsang Tsui Ash Lagoon	Community

- 3.3.3 The status and locations of dust sensitive receivers may change from time to time. If such cases exist, the ET Leader shall propose updated monitoring locations and seek approval from SM and IEC and agreement from EPD on the proposal.

3.4 MONITORING EQUIPMENT

1-hour TSP

- 3.4.1 Portable direct reading dust meters brand named “Sibata LD-5R Laser Dust monitor Particle Mass Profiler & Counter” and “Sibata LD-3B Laser Dust monitor Particle Mass Profiler &

Counter” were used to 1-hour TSP measurement. These portable direct reading dust meters provided a real time 1-hour TSP measurement based on 90° light scattering.

- 3.4.2 The portable direct reading dust meters were used within the valid period following manufacturer’s Operation and Service Manual. It was calibrated annually and determined periodically by the calibrated High-Volume Sampler to check the validity and accuracy of the results measured by direct reading method. The proposed use of portable direct reading dust meters was submitted to the IEC and obtained agreement and stated in **Section 4.3** of the Updated EM&A Manual.
- 3.4.3 The portable direct reading dust meters used for impact air quality monitoring are listed in **Table 3-2**. The copies of calibration certificates for 1-hour TSP air quality monitoring equipment are shown in **Appendix E1**.

Table 3-2 1-hour TSP Air Quality Monitoring Equipment

Equipment	Model	Serial No.
Portable Dust Meter of Particle Mass Profiler & Counter	Sibata LD-3B Laser Dust monitor	456659 (AUES Equipment No. EQ116)
		456660 (AUES Equipment No. EQ117)
		456662 (AUES Equipment No. EQ118)
	Sibata LD-5R Laser Dust monitor	3Y7142 (AUES Equipment No. EQ124)
		467389 (AUES Equipment No. EQ125)
		5Y8215 (AUES Equipment No. EQ129)

24-hour TSP

- 3.4.4 The 24-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the *Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B*. The filter paper of 24-hour TSP measurement shall be provided and determined by HOKLAS accredited laboratory. Equipment used for 24- hour TSP of impact air quality monitoring is listed in **Table 3-3**.

Table 3-3 24-hour TSP Air Quality Monitoring Equipment

Equipment	Model
High Volume Air Sampler	TISCH High Volume Air Sampler, HVS Model TE-5170
Calibration Kit	TISCH Model TE-5025A

- 3.4.5 The equipment used for 24-hour TSP measurement is a Tisch Environmental, Inc. Model TE-5170 TSP high volume air sampling system, which complied with EPA Code of Federal Regulation, Appendix B to Part 50. The High Volume Sampler (HVS) consists of the following:
- (i) An anodized aluminum shelter;
 - (ii) A 8”x10” stainless steel filter holder;
 - (iii) A blower motor assembly;
 - (iv) A continuous flow/pressure recorder;
 - (v) A motor speed-voltage control/elapsed time indicator;
 - (vi) A 7-day mechanical timer, and
 - (vii) A power supply of 220v/50 Hz
- 3.4.6 Prior to the 24-hour TSP monitoring, the HVS was calibrated in accordance with the manufacturer’s instruction using the NIST-certified standard calibrator (Tisch Calibration Kit Model TE-5025A). Valid calibration certificate of the calibration kit with the certificate of HVS calibrated are attached in **Appendix E1**.

Wind Data Monitoring Equipment

- 3.4.7 In consideration of the safety concerns of setting up wind sensor at 10m above ground, the ETL proposed alternative method to obtain representative wind data. Meteorological information as extracted from “the Hong Kong Observatory Lau Fau Shan Station” is alternative method to obtain representative wind data. Lau Fau Shan Station is located nearby the Project site. Moreover, Lau Fau Shan station is located at 31m above mean sea level which in compliance with the general setting up requirement. This station can also provide other meteorological information include air temperature, relative humidity, wind direction, wind speed and mean sea level pressure. Adoption of meteorological information from Hong Kong Observatory is a common alternative method for a lot of EM&A projects in Hong Kong.

3.5 MONITORING PROCEDURES

1-hour TSP

- 3.5.1 The portable direct reading dust meters brand named “Sibata LD-5R Laser Dust monitor Particle Mass Profiler & Counter” and “Sibata LD-3B Laser Dust monitor Particle Mass Profiler & Counter” was used for impact monitoring. It is a portable, battery-operated laser photometer and provides a real time 1-hour TSP measurement based on 90° light scattering.
- 3.5.2 The 1-hour TSP meter used is within the valid period, calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter was follow manufacturer’s Operation and Service Manual.

24- hour TSP

- 3.5.3 Prior of 24-hour TSP monitoring, the HVS was calibrated in accordance with the manufacturer’s instruction using the NIST-certified standard calibrator (Tisch Calibration Kit Model TE-5025A). The 24-hour TSP Monitoring using the HVS was also processed in accordance with the manufacturer’s Operations Manual.
- 3.5.4 A filter paper of 24- hour TSP on filters of HVS collected by the ET would be delivered to ALS Technichem (HK) Pty Ltd (ALS) carry out quantifies. Also, ALS will keeps all the sampled 24-hour TSP filter papers in normal air conditioned room conditions, i.e. 70% RH (Relative Humidity) and 25°C, for six months prior to disposal.

3.6 ACTION/LIMIT LEVELS FOR AIR QUALITY

- 3.6.1 The baseline results form the basis for determining the environmental acceptance criteria for the impact monitoring. Following the guidelines for establishing the Action and Limit Levels for air quality monitoring, the Action and Limit Levels are presented in **Table 3-4**. Should project-related non-compliance of the environmental quality criteria occur, remedial actions will be triggered according to the Event and Action Plan which is presented in **Appendix G**.

Table 3-4 Action and Limit Levels for Air Quality Monitoring

Monitoring Station	1-hour TSP		24-hour TSP	
	Action Level ($\mu\text{g} / \text{m}^3$)	Limit Level ($\mu\text{g} / \text{m}^3$)	Action Level ($\mu\text{g} / \text{m}^3$)	Limit Level ($\mu\text{g} / \text{m}^3$)
AM(D)1	317	500	155	260
AM(D)2	313	500	156	260
AM(D)3	334	500	155	260
AM(D)5a	371	500	238	260
AM(D)6a	294	500	159	260

Monitoring Station	1-hour TSP		24-hour TSP	
	Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level ($\mu\text{g}/\text{m}^3$)	Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level ($\mu\text{g}/\text{m}^3$)
AM(D)7b	331	500	215	260

3.7 AIR QUALITY MONITORING RESULTS

3.7.1 The monitoring schedule is presented in *Appendix H* and the monitoring results are summarized in the following sub-sections.

3.7.2 The monitoring results are summarized in *Tables 3-5 and Table 3-6*. The detailed 1-hour TSP and 24-hour monitoring results are provided in *Appendix I* and graphical plots of monitoring results are shown in *Appendix J*.

Table 3-5 Summary of 1-hour TSP Monitoring Results

1-hour TSP ($\mu\text{g}/\text{m}^3$)				
Monitoring Station	Average (Range)	No. of Session	Action Level	Limit Level
AM(D)1 - Village house at Ha Pak Nai	79 (40 – 153)	30	317	500
AM(D)2 - Village house at Ha Pak Nai	63 (40 – 91)	30	313	500
AM(D)3 - Village house at Ha Pak Nai	59 (31 – 135)	30	334	500
AM(D)5a - Lung Kwu Sheung Tan	139 (41 – 267)	30	371	500
AM(D)6a - Rooftop of T·Park Workshop	68 (38 – 144)	30	294	500
AM(D)7b - Site boundary of West Tsang Tsui Ash Lagoon	52 (32 – 106)	30	331	500

Table 3-6 Summary of 24-hour TSP Monitoring Results

24-hour TSP ($\mu\text{g}/\text{m}^3$)				
Monitoring Station	Average (Range)	No. of Session	Action Level	Limit Level
AM(D)1 - Village house at Ha Pak Nai	59 (22 – 127)	10	155	260
AM(D)2 - Village house at Ha Pak Nai	35 (21 – 52)	10	156	260
AM(D)3 - Village house at Ha Pak Nai	40 (14 – 99)	10	155	260
AM(D)5a - Lung Kwu Sheung Tan	112 (42 – 187)	10	238	260
AM(D)6a - Rooftop of T·Park Workshop	52 (24 – 123)	10	159	260
AM(D)7b - Site boundary of West Tsang Tsui Ash Lagoon	34 (14 – 87)	10	215	260

3.7.3 In the Reporting Period, all the 1-hour and 24-hour TSP monitoring results were below the Action/Limit Levels and no corrective action was therefore required.

4 CONSTRUCTION NOISE MONITORING

4.1 MONITORING REQUIREMENTS

- 4.1.1 Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). $L_{eq30min}$ shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. For all other time periods, L_{eq5min} shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. As supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 4.1.2 In case of non-compliance with the construction noise criteria, more frequent monitoring as specified in the Event and Action Plan shall be carried out. This additional monitoring shall be continued until the recorded noise levels are rectified or proved to be irrelevant to the construction activities.

4.2 MONITORING PARAMETER, FREQUENCY AND DURATION

- 4.2.1 During normal construction working hour (0700-1900 Monday to Saturday), monitoring of $L_{eq30min}$ noise levels (as 6 consecutive L_{eq5min} readings) shall be carried out at the designated monitoring location NM1- Ha Pak Nai once every week.

4.3 MONITORING LOCATIONS

- 4.3.1 According to the updated EM&A Manual, the ET shall carry out noise monitoring during the construction phase at the designated monitoring station as shown in **Table 4-1** and illustrated in **Appendix D**.

Table 4-1 Construction Noise Monitoring Station

Monitoring ID	EIA NSR Ref	Location	Type of Monitoring	Monitoring Parameters	Supplementary Information
NM1	NSR-1	Village house at Ha Pak Nai	Construction & Operation	30mins and or 5mins of L_{Aeq}	L_{A10} and L_{A90}

4.4 MONITORING EQUIPMENT

- 4.4.1 As referred to in the Technical Memorandum (TM) issued under the NCO, sound level meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications were used for carrying out the noise monitoring. Immediately prior to and following each noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements would be accepted as valid only if the calibration level from before and after the noise measurement agrees to within 1.0 dB.
- 4.4.2 Noise measurements were made in accordance with standard acoustical principles and practices in relation to weather conditions. Weather information such as wind speed and wind direction would be extracted from Lau Fau Shan weather station during the impact monitoring.
- 4.4.3 The ET was responsible for the provision, installation, operation, maintenance, dismantle of the monitoring equipment. Sufficient noise measuring equipment and associated instrumentation are available for carrying out the impact monitoring. The equipment and associated instrumentation have been clearly labelled.

4.4.4 Noise monitoring equipment used for impact monitoring is listed in **Table 4-2**.

Table 4-2 Noise Monitoring Equipment

Equipment	Model	Serial No.
Integrating Sound Level Meter	Rion NL-52A / B&K2238	00620666 / 2285722
Calibrator	Rion NC-74	34246492

4.4.5 Sound level meter listed above comply with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications, as recommended in Technical Memorandum (TM) issued under the Noise Control Ordinance (NCO), which was used for impact noise monitoring. The copies of calibration certificates of noise monitoring equipment were shown in **Appendix E2**.

4.5 MONITORING PROCEDURES

4.5.1 The microphone of the sound level meter was set at a height of about 1.5m subject to site condition and oriented pointed to the site, with the microphone facing perpendicular to the line of sight. Moreover, the microphone was positioned away from any reflective surface, and a correction of +3 dB(A) has been made for the free field measurements.

4.5.2 Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. The calibration level from before and after the noise measurement agrees to within 1.0dB.

4.5.3 $L_{eq30min}$ shall be taken as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. After the measurement, the data were recorded and stored automatically within the sound level meter system. At the end of the monitoring period, noise levels in term of L_{eq} , L_{90} and L_{10} were recorded.

4.5.4 All the monitoring data stored in the sound level meter system were downloaded through the computer software, and all these data were checked and reviewed on computer.

4.6 ACTION AND LIMIT LEVELS FOR CONSTRUCTION NOISE

4.6.1 Following the guidelines for establishing the Action and Limit Levels for construction noise monitoring, the Action and Limit Levels are presented in **Table 4-3**. Should project-related non-compliance of the environmental quality criteria occur, remedial actions will be triggered according to the Event and Action Plan which is presented in **Appendix G**.

Table 4-3 Action and Limit Levels for Construction Noise

Monitoring Location	Action Level	Limit Level in dB(A)
	Time Period: 0700-1900 hours on normal weekdays	
NM1	When one or more documented complaints are received	75 dB(A)
<i>Note: If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit issued by the NCA have to be followed.</i>		

4.7 NOISE MONITORING RESULTS

4.7.1 The monitoring schedule is presented in **Appendix H** and the monitoring results are summarized in the following sub-sections.

4.7.2 In the Reporting Period, 4 sessions of noise measurements were carried out at designated

monitoring station NM1. The noise monitoring results are summarized in **Table 4-4**. The detailed noise monitoring data are presented in **Appendix I** and the relevant graphical plots are shown in **Appendix J**.

Table 4-4 Summary of Construction Noise Monitoring Results

Construction Noise Level ($L_{eq30min}$), dB(A)					
Station ID	Description of location	Range	No. of Sessions	Action Level	Limit Level
NM1	Village house at Ha Pak Nai	50 - 59	4	When one documented complaint is received at anytime during the construction period	75

Remarks

(*) *Noise measurements was conducted at free field condition and façade correction (+3 dB(A) was added according to acoustical principles and EPD guidelines*

- 4.7.3 As shown in **Table 4-4**, no construction noise measurement results triggered the Limit Level (75 dB(A)) in the Reporting Month. Due to the construction programme, construction works during restricted hour was commenced from 15 November 2024. According to site inspection and auditing on Contractor's record have shown that the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority for construction works during restricted hours were followed. Thus, the stipulated requirement on noise impact control during restricted hour was achieved.
- 4.7.4 Furthermore, no valid noise complaint (which triggered Action Level exceedance) was recorded in the Reporting Period.

5 WATER QUALITY MONITORING

5.1 MONITORING REQUIREMENTS

- 5.1.1 According to the updated EM&A Manual, the Contractor shall carry out surface water monitoring from the commencement of the works until the issue of the Aftercare Certificate.
- 5.1.2 According to general water quality monitoring criteria, water sampling depth should be:
- If the water depth during sampling is exceeded 6m, three depths: 1m below water surface, 1m above river/stream bed and mid-depth.
 - If the water depth during sampling is exceeded 3m but less than 6m, two depths: 1m below water surface and 1m above river/stream bed.
 - If the water depth is less than 3m, one depth: perform at mid-depth.
- 5.1.3 Duplicate samples and repeat in-situ measurement shall be taken from each sampling depth.

5.2 MONITORING FREQUENCY AND DURATION

- 5.2.1 During the construction phase, monthly monitoring of the surface water discharges shall be carried out in order to show if contamination of surface water by leachate is occurring.

5.3 MONITORING LOCATIONS

- 5.3.1 The surface water monitoring should be carried out at the specified point WM1 in accordance with Figure 5.1 in the updated EM&A Manual, which is shown in **Appendix D**, unless otherwise agreed by IEC and approved by the SM.

5.4 ANALYSIS PARAMETERS

- 5.4.1 According to Section 5.5 of the updated EM&A Manual, the parameters of surface water monitoring included in-situ measurement and laboratory analysis are listed below.

A. In-situ measurement:

Temperature (°C), pH (unit), Salinity (ppt), Turbidity (NTU), Dissolved Oxygen (DO) (mg/L) & Dissolved Oxygen Saturation (DOS) (%), Electrical Conductivity (µS/cm), Water Flow direction (degree) / speed (m/s) and Water depth (m).

B. Laboratory Analysis (mg/L):

Alkalinity, Chemical Oxygen Demand (COD), 5-day Biochemical Oxygen Demand (BOD₅), Total Organic Carbon (TOC), Suspended Solids (SS), Ammonia Nitrogen (NH₃-N), Total kjeldahl nitrogen, Nitrate (NO₃), Sulphate & Sulphite, Phosphate, Chloride and Oil & Grease.

C. Laboratory Analysis:

Sodium (µg/L) and Coliform Count (cfu/100mL).

D. Heavy Metals Analysis(µg/L):

Magnesium (Mg), Calcium (Ca), Potassium (K), Iron (Fe), Nickel (Ni), Zinc (Zn), Manganese (Mn), Copper (Cu), Lead (Pb) and Cadmium (Cd).

5.5 MONITORING EQUIPMENT

- 5.5.1 Water quality monitoring equipment used for impact monitoring is listed in **Table 5-1**.

Table 5-1 Surface Water Monitoring Instrument

Equipment	Model	Serial No.
A Digital Global Positioning System	Garmin eTrex	N/A
Thermometer & DO meter	YSI Professional DSS Multifunctional Meter	[20J101862/15H103928]/[EQW018]

Equipment	Model	Serial No.
pH meter		
Turbidimeter		
Salinometer		
Conductivity meter		
Current Meter	Valeport Model 106 Current Meter	[60011]
Sample Container	High density polythene bottles provided by laboratory	N/A
Storage Container	'Willow' 33-liter plastic cool box with ice pad	N/A

5.5.2 All in-situ measurement instruments such as DO measuring instruments, turbidity measuring instruments, salinometer and A portable pH meter, would be calibrated by HOKLAS accredited laboratory at three-month intervals. Valid calibration certificate is attached in *Appendix E3*

5.6 LABORATORY ANALYSIS

5.6.1 A local HOKLAS-accredited laboratory (ALS Technichem (HK) Pty Ltd HOKLAS registration number: HOKLAS 066) was appointed as a testing laboratory to carry out chemical analytical. The HOKLAS accredited certificate of laboratory is shown in *Appendix E3*. The determination was started within 24 hours or recommended hold time of collection of water samples. The method of chemicals analysis is shown below *Table 5-2*.

Table 5-2 Test Method and Reporting Limit of Chemicals Analysis

Analyte Description	ALS Method Code	Method Reference	Limit of Reporting (LOR)
pH value @25°C	EA002	APHA 4500 H: B	0.1 pH Unit
Conductivity @25°C	EA010	APHA 2510 B	1µS/cm
Suspended Solids	EA025-LL**	APHA 2540 D	0.1mg/L
Total Alkalinity as CaCO ₃	ED037	APHA 4500 H: B	1mg/L
Sulphate as SO ₄	ED041K	USEPA 375.4	1mg/L
Chloride	ED045K	USEPA 325.1	0.5mg/L
Cadmium	EG020 T	USEPA 6020	0.2µg/L
Copper			1µg/L
Lead			1µg/L
Manganese			1µg/L
Nickel			1µg/L
Zinc			10µg/L
Calcium	EG032 T	USEPA 6010	50µg/L
Iron			10µg/L
Magnesium			50µg/L
Potassium			50µg/L
Sodium			50µg/L
Ammonia as N	EK055K	APHA 4500 NH ₃ G	0.01mg/L
Nitrate as N	EK058A	APHA 4500 NO ₃ : I	0.01mg/L
Total Kjeldahl Nitrogen as N	EK061A	APHA 4500 Norg: D; USEPA 1688	0.1mg/L
Reactive Phosphorus as P	EK071K	APHA 4500 P: B & F	0.01mg/L
Sulphite as SO ₃ ²⁻	EK086 **	APHA 4500 SO ₃ : B	2mg/L
Total Organic Carbon	EP005	APHA 5310 B	1mg/L
Oil and Grease	EP020	APHA 5520 B	5mg/L
Chemical Oxygen Demand	EP026C	APHA 5220 C	5mg/L

Analyte Description	ALS Method Code	Method Reference	Limit of Reporting (LOR)
(COD) (Closed Reflux method)			
Biochemical Oxygen Demand (BOD)	EP030	APHA 5210 B	2mg/L
Total Coliforms	EM003	DoE section 7.8, 7.9.4.1 & 3	1 CFU/100mL

Remarks: Except ** Item, all the methods as quoted is HOKLAS accredited

5.7 MONITORING PROCEDURES

- 5.7.1 Prior to conducting in-situ measurement and water sampling, general information such as the sampling date, time, weather conditions and the personnel responsible for the monitoring would be recorded on the field data sheet. The location of water quality monitoring station was confirmed using GPS prior to in-situ monitoring and sampling. Moreover, the water depth at the monitoring station will be measured using a portable digital global positioning system.
- 5.7.2 In order to collect sufficient impact data, surface water monitoring will be conducted at two specific tide points: one mid-ebb and one mid-flood.
- 5.7.3 Before the surface water sampling, water flow and direction would be measured by Valeport Current Meter. Moreover, water temperature, DO & DOs, pH, salinity, conductivity and turbidity were taken by YSI Professional DSS Multifunctional Meter. These measurement results would be downloaded from instruments and recorded.
- 5.7.4 As the water depth was less than 3m, in-situ measurement and water sampling was conducted at mid-depth only. Water samples were collected repeatedly using the water sampler to obtain adequate water volumes for laboratory analysis. All the obtained water volumes would be directly filling into sample container as provided by the testing laboratory. Also, sample container would be pre-labeled with date, location, tide, depth, parameters and replicate information of the sample. The water sampler would be rinsed using local marine water before it used to collect marine water sample. Container is sealed with a screw cap after completed water filling then packed in cool box (maintain 4°C without being frozen) and delivered to the laboratory on the same day of sample collection for analysis. Also, the water sample filled into container until no remaining air space and then the lid securely screwed on. Where samples are to be preserved with acid or alkalis prior to transport to the laboratory, the sample bottles would be filled to the specified level which advised by the testing laboratory.
- 5.7.5 Before each round of monitoring, the dissolved oxygen probe would be calibrated by wet bulb method; a zero check in distilled water would be performed with the turbidity and salinity probes; 4 and 10 values of the standard solution would be undertaken to check the accuracy of pH value.
- 5.7.6 Additionally, the laboratory will retain all water samples after analysis for a period of 3 months, allowing for the possibility of repeat analysis if needed.

5.8 DATA MANAGEMENT AND QUALITY ASSURANCE (QA)/QUALITY CONTROL (QC)

- 5.8.1 All monitoring data would be handled by AUES's in-house data recording and management system. The monitoring data recorded in the equipment would be downloaded directly from the equipment at the end of each monitoring day and input into a computerized database maintained by the AUES. The laboratory results would be input directly into the computerized database and checked by personnel other than those who input the data.

- 5.8.2 For monitoring parameters that require laboratory analysis, the testing laboratory would be according with the QA/QC requirements as set out under the HOKLAS scheme for the relevant laboratory tests.

Action/Limit Levels for Surface Water Quality

- 5.8.3 Following above guidelines for establishing the Action and Limit Levels for surface water quality monitoring, the Action and Limit Levels of the Project are presented in **Table 5-3**.

Table 5-3 Action and Limit Levels for Surface Water Monitoring during Construction Phase

Monitoring Parameter	Action Level	Limit Level
DO mg L ⁻¹	6.4	4.0
pH, (unit)	Beyond the range of 6.5 to 8.5	Beyond the range of 6 to 9
Turbidity, NTU	23.4	34.1
SS, mg L ⁻¹	47.3	50.0

5.9 RESULTS OF SURFACE WATER QUALITY MONITORING

- 5.9.1 The monitoring schedule is presented in **Appendix H** and the monitoring results are summarized in the below sections.
- 5.9.2 Surface water quality monitoring was carried out at the designated monitoring station WM1 on **5th June 2026**. As the water depth at WM1 was less than 3m, in-situ measurement and water sample collection were conducted at mid-depth.
- 5.9.3 There are no exceedances recorded for surface water monitoring. The monitoring results including in-situ measurement and laboratory analysis are shown in **Appendix I** and the relevant graphical plots are shown in **Appendix J**.

6 ECOLOGY MONITORING

6.1 REQUIREMENTS

- 6.1.1 The EIA stipulated that ecological monitoring should be undertaken throughout the design, construction, operation, restoration and aftercare phases of WENT Landfill Extension to ensure that all mitigation measures should be fully complied with. The objectives of design audit for ecology are to ensure that the design for ecological mitigation specified in the EIA Report will be conducted to ensure that such designs are ecologically feasible and effective.
- 6.1.2 The performance of monitoring and audit from an ecological prospective should be integrated with the overall monitoring and audit plan for the project as a whole. The information on the commencement and programme of the engineering works should enable the ecological monitoring to be prepared with considerations of seasonality factors. An EMIS of the recommended mitigation measures is presented in **Appendix M**.

6.2 ECOLOGICAL MITIGATION MEASURES

- 6.2.1 Ecological mitigation measures to be implemented before commencement of relevant construction phase should include survey and transplantation of plant species of conservation interest and setting up water quality monitoring stations inside Tai Shui Hang catchment to monitor the conditions of the habitat for the rare freshwater fish, *Acrossocheilus parallens*. In addition, although potential impacts to stream loss and fish species of conservation interest are ranked as minor and insignificant and no mitigation is required, a precautionary measure – fish capture and translocation survey for the three fish species of conservation interest including *Squaliobarbus curriculus*, *Osteochilus vittatus* and *Kuhlia marginata* will also be implemented before site clearance.

6.3 MONITORING AND AUDIT FOR ECOLOGY

- 6.3.1 The ecological monitoring and audit programme in relation to construction phase would be survey and transplantation of the plant species of conservation interest and 2 years of monitoring after.
- 6.3.2 According to the EIA Report, four plant species of conservation interest were found and directly impacted by the WENT Landfill Extension in June 2009. However, during the latest field survey in January 2024, only three groups of *Nepenthes mirabilis* (Pitcher Plant) could be found, and the remaining mentioned plants were not located. For *Ixonanthes reticulata* recorded at Tsang Kok Stream from the VEP were not found during the survey in January 2024. If *Ixonanthes reticulata* is found in the future, further assessment will be carried out to review the feasibility of transplantation.
- 6.3.3 Upon completion of transplantation, monitoring should be implemented for 2 years. The health and condition of individuals of the transplanted plant species of conservation interest should be monitored during the first 2 years after transplantation. Monitoring should be conducted monthly during first 6 months, and bi-monthly in the next 18 months to ensure survival. Since die-back of current year's growth is not uncommon, new stems, leaves and/or flowers produced from the cuttings in the following years, if observed in the following season, should be marked separately but also counted as survived individuals.
- 6.3.4 The Pitcher Plant transplantation was carried out in March 2026. Regular inspection had been carried out for pitcher plant and temporary nursery site accordingly. The relative photo record are shown in **Appendix P**.
- 6.3.5 The CLP 132 kV cable will be constructed for the power supply of the permanent crushing plant at Portion A1. Therefore, the ecological study for the alignment of 132kV cable had

been carried out and concluded that no adverse impact will be caused for the 132kV cable construction. The habitat map with photo record was attached in the Project's Monthly EM&A Report July 2025.

7 LANDSCAPE AND VISUAL MONITORING

7.1 MONITORING REQUIREMENTS

7.1.1 The EIA study has recommended landscape and visual mitigation measures to be undertaken during the construction and operation phases, as well as the restoration and aftercare phases of the project. Compared with the approved WENTX EIA, two new visual sensitive receivers (VSRs) within the visual envelop from the boundary of the Project are identified. Other VSRs are the same as the EIA. This section outlines the EM&A requirements of these measures to mitigate the landscape and visual impacts. An EMIS of the recommended mitigation measures is presented in *Appendix M*.

7.1.2 Measures to mitigate the landscape and visual impacts during the construction and operation phases should be checked to ensure compliance with the intended aims of the measures. The progress of the engineering works should be regularly reviewed on site to identify the earliest practical opportunities for the landscape works to be undertaken. The event and action plan for landscape and visual monitoring during the construction phase is summarised in *Appendix G*.

7.2 MONITORING AND OBSERVATION

7.2.1 In order to monitor the landscape and visual impact after providing mitigation measures effectively, all the specified and affected landscape character areas, landscape resources and visually sensitive receivers should be monitored. Implementation of mitigation measures during construction phase of the Project has been monitored through regular site inspection/audit. Photo record for the transplanted tree at receptor site of Portion B4 and 30m tree buffer zone are presented in *Appendix O*.

7.3 LANDSCAPE AND VISUAL RELATED SUBMISSION

7.3.1 In accordance with the requirements of the EM&A Manual, the transplantation scheme and detailed vegetation survey report for the Pitcher Plant have been submitted. The Pitcher Plant transplantation was carried out in this reporting period. These documents were previously included in the Project's Monthly EM&A Report for January 2026. Moreover, the Detailed Transplantation Protocol and Monitoring Programme for Pitcher Plant prepared by HKRRP was presented in Project's Monthly EM&A Report February 2026.

7.3.2 Following receipt of comments from AFCD, updated versions of the transplantation scheme and have been prepared by HKRRP. The updated transplantation scheme and the original submitted detailed vegetation survey report was presented in Project's Monthly EM&A Report February 2026.

8 LANDFILL GAS MONITORING

8.1 REQUIREMENT

- 8.1.1 Landfill gas (LFG) monitoring should commence at the start of specific construction works, such as excavation and drilling for blasting, and through the operation, restoration and until completion of aftercare phases. The measured LFG results should be checked for compliance against pre-defined A/L Levels in this EM&A Manual. In case exceedance of compliance level was detected at any locations, the EAP should be triggered for necessary action to be taken.

8.2 MONITORING PARAMETERS

A suite of LFG monitoring parameters include:

Monitoring Method	Monitoring Parameters	Requirement of Monitoring
• Monitoring borehole:	Methane (CH ₄), carbon dioxide (CO ₂), oxygen (O ₂), flammable gas	If the blasting works are within the 250m consultation zone of WENT Landfill, gas monitoring shall be conducted at the nearest monitoring boreholes(#).
• Surface gas location:	CH ₄ , CO ₂ , O ₂	For excavation works between 300mm and 1m deep and deeper than 1m; and throughout the whole process of the blasting
• Gas well head:	CH ₄ , CO ₂ , O ₂ , flammable gas, volatile organic compounds (VOC)	Once the gas well(#) is set up
• Off-site location:	VOC	Once WENTX starts receiving waste

Remark: (#) Monitoring boreholes will be installed for LFG monitoring at the borehole and gas well head. The programme for borehole installation will be synchronized with the construction programme.

- 8.2.1 The existing WENT Landfill is required to conduct LFG monitoring during landfill operation from drillholes, boreholes, gas probes and piezometers around the perimeter of the Site as specified in their contract. Before setting up the monitoring boreholes for WENTX, the Contractor should refer to the monitoring data collected from the existing WENT Landfill. This data serves as a reference and provides valuable information regarding historical gas levels and trends at the site.

8.3 MONITORING EQUIPMENT

Monitoring for Construction Works

- 8.3.1 Intrinsically safe portable gas detectors should be used during excavation or when working in any confined spaces, which have the potential for presence of LFG and risk of explosion or asphyxiation. The monitoring equipment should alarm, both audibly and visually, when the concentrations of the following gases were exceeded:
- CH₄: > 10% of the Lower Explosion Limit (LEL);
 - CO₂: > 0.5% by volume; and
 - O₂: < 19% by volume

Calibration and Maintenance

- 8.3.2 All portable instrument should be calibrated and serviced according to the manufacturer's instructions. Calibration gases should be used for checking portable instrument for methane and carbon dioxide detection before and after use. Instrument for monitoring oxygen should

be calibrated against normal expected air concentrations. Any significant variations in instrument performance outside that expected through normal drift should be noted with the instrument calibration timely corrected.

- 8.3.3 Gas analyser was used for carrying out LFG monitoring for Construction Works. **Table 8-1** summarises the equipment that were used in the LFG monitoring programme and the calibration certificates are shown in *Appendix E4*.

Table 8-1 LFG Monitoring Equipment

Monitoring Parameter	Equipment	Model	Serial No.
CH ₄ , CO ₂ & O ₂	Gas Analyser	SKY3000-R5	02100C61C8003
		GEM5000	G510348

8.4 MONITORING LOCATIONS

- 8.4.1 During the construction stage, when excavation of 1m deep or more, surface LFG concentrations should be monitored at before entry and periodically during the progress of works.
- 8.4.2 The blasting work is scheduled to be carried out in 6 Phases and during Phase 1, the Contractor will utilise the existing WENT's monitoring wells for carrying out landfill gas monitoring as the WENTX landfill gas monitoring boreholes have yet to be completed. However, the Contractor is committed to complete the proposed landfill gas monitoring boreholes along the WENTX waste boundary for both Phase 1 and 2 blasting areas while Phase 1 blasting work is being carried out and so on for subsequent phases. In other words, when the blasting work is completed for Phase 1, the landfill gas monitoring boreholes for subsequent phase (i.e. Phase 2) is also complete and likewise for subsequent Phases. After Phase 1 blasting work is completed, WENT's monitoring wells will no longer be needed as the next phase proposed monitoring wells would have already been constructed. The landfill gas monitoring will be carried out in accordance with the requirement either within 250m consultation zone of the WENT Landfill or within 250m from the waste boundary of the WENT landfill extension site.

8.5 MONITORING FREQUENCY

- 8.5.1 The monitoring frequency and areas to be monitored should be set down prior to commencement of groundworks either by the Registered Safety Officer or by an appropriately qualified person. Routine monitoring should be carried out the in slope cutting by blasting, in all excavations, manholes and chambers and any other confined spaces that may have been created by, for example, the temporary storage of building materials on the site surface. All measurements in excavations should be made with the monitoring tube located not more than 10mm from the exposed ground surface.
- 8.5.2 The Contractor will maintain close liaison with WENT Landfill operator on a weekly basis and provide a two weeks tentative blast schedule at least 1 week before the blasting work. The tentative blast schedule will include the schedule blast date, location of blast works and the approximate separation distance between the blast area and existing WENT Landfill boundary.
- 8.5.3 The frequency and the locations of the LFG monitoring within the excavation area should be determined prior to commencement of the blasting works. The monitoring requirements and procedures specified in *Paragraphs 8.23 to 8.28 of the EPD's Landfill Gas Hazard Assessment Guidance Note* shall be strictly followed.

A. For blasting works on existing slope

The Contractor will perform landfill gas monitoring for all blasting works within the 250m consultation zone of the WENT Landfill (i.e. plan distance from the edge of the existing waste boundary of WENT Landfill site) at the schedule below.

- The Contractor will inform WENT Landfill operator about the selected perimeter monitoring wells along WENT's landfill boundary for landfill gas monitoring that may be required. When existing WENT's monitoring wells are proposed, permission from WENT's Landfill operator must be obtained.
- The Contractor will carry out landfill gas monitoring at the nearest monitoring wells (within 250m from WENT boundary) and the results shall be reported to the Service Manager. If the methane concentration is measured and remained to be less than 1%, drilling of blast holes can be proceeded after receiving confirmation from the Service Manager.
- Drilling of blast holes will take multiple days, thus, landfill gas monitoring shall be carried out every morning at the nearest blast hole following the same procedure as mentioned above prior to resume drilling work.

i) Surface Emission Monitoring

- a walkover survey for surface gas emission to be undertaken within the blasting area, with a portable gas measuring probe to detect the air condition at about 10 millimeters above the ground level to ensure no LFG is present.

B. For excavation works deeper than 1m

i) Measurements should be made:

- at ground surface before excavation work commences;
- immediately before any worker enters the excavation;
- at the beginning of each working day for the entire period the excavation remains open; and
- periodically through the working day whilst workers are in the excavation.

C. For excavation between 300mm and 1m deep

i) Measurements should be made:

- directly after the excavation has been completed; and
- periodically whilst the excavation remains open.

8.5.4 For excavations less than 300mm deep, monitoring may be omitted, at the discretion of the Safety Officer or other appropriately qualified person.

8.5.5 During the construction (specific construction works) operation, restoration and until completion of aftercare phases, LFG monitoring should be conducted in monthly basis at designated monitoring locations and gas monitoring boreholes, supplemented by monthly site surveys of the surrounding environment including natural cracks and fissures, service drains and ducts, area with sign of vegetation death, and any below ground enclosed spaces. If the monitoring results indicate evidence of gas migration, the monitoring frequency should be increased accordingly, with the implementation of appropriate mitigation measures under the EAP.

8.5.6 Moreover, baseline LFG monitoring at landfill gas well was conducted in this reporting month to fulfil the EM&A Manual requirement. Separate operation baseline LFG monitoring report will be submitted after the baseline monitoring has been completed.

8.5.7 The monitoring frequency should be reviewed throughout the on-going development of WENT Landfill Extension and revised as necessary based on the LFG monitoring data.

8.6 A/L LEVELS AND EVENT ACTION PLAN

8.6.1 The A/L Levels and relevant EAP for LFG detected in excavation, utilities and enclosed onsite areas are summarised in **Table 8-2**.

Table 8-2 A/L Levels and EAP for LFG

Parameter	Level	Action
Oxygen (O ₂)	Action Level <19% O ₂	Ventilate trench/void to restore O₂ to >19%
	Limit Level <18% O ₂	- Stop works - Evacuate personnel/prohibit entry - Increase ventilation to restore O₂ to >19%
Methane (CH ₄)	Action Level >10% LEL*	- Prohibit hot works - Increase ventilation to restore CH₄ to <10% LEL
	Limit Level >20% LEL	- Stop works - Evacuate personnel/prohibit entry - Increase ventilation to restore CH₄ to <10% LEL
Carbon dioxide (CO ₂)	Action Level** >0.5%** CO ₂	Ventilate to restore CO₂ to < 0.5%
	Limit Level >1.5% CO ₂	- Stop works - Evacuate personnel / prohibit entry - Increase ventilation to restore CO₂ to <0.5%

* LEL: Lower Explosive Limit – concentrations in air below which there is not enough fuel to continue an explosion.

** This Action Level of CO₂ at 0.5% is set for reference only, assuming no CO₂ emission from a particular location. Depending on the baseline CO₂ levels, the Action Level at a particular location will be changed.

8.7 MONITORING RESULTS

8.7.1 The LFG monitoring was conducted for excavation work in **June 2026**. The LFG monitoring results are summarized in **Appendix I**.

8.7.2 No exceedance of Limit Levels of LFG was recorded during the Reporting Period.

8.7.3 No effect that arose from the other special phenomena and work progress of the concerned site was noted during the current monitoring month.

9 WASTE MANAGEMENT

9.1 GENERAL WASTE MANAGEMENT

9.1.1 Waste management was carried out in accordance with the Waste Management Plan for the Contract.

9.2 RECORDS OF WASTE QUANTITIES

9.2.1 All types of waste arising from the construction work are broadly classified into the following:

- Inert construction & demolition (C&D) Material; and
- Non-inert C&D waste

9.2.2 The Contractor is advised to minimise the wastes generated through recycling or reusing. All mitigation measures stipulated in the updated EM&A Manual and waste management plans shall be fully implemented.

9.2.3 The quantities of waste for disposal of in this Reporting Period are summarized in **Tables 9-1** and **9-2** and they are made reference to the Waste Flow Table provide by the Contractor which shown in **Appendix K**.

Table 9-1 Summary of Quantities of Inert C&D Materials

Type of Waste	Quantity
Total generated C&D Materials (Inert) (in '000m ³)	11.463
Reused in this Contract (Inert) (in '000m ³)	11.463
Reused in other Projects (Inert) (in '000m ³)	0
Disposal as Public Fill (Inert) (in '000m ³)	0

Table 9-2 Summary of Quantities of Non-inert C&D Wastes

Type of Waste	Quantity
Recycled Metals (in kg)	4.700
Recycled Paper / Cardboard Packaging (in kg)	6.200
Recycled Plastics (in kg)	7.600
Chemical Waste (in liter)	1600.00
Chemical Waste (in '000kg)	0
Yard Waste (in tonne)	0
General Refuse (in '000m ³)	0.365

10 SITE INSPECTION

10.1 REQUIREMENTS

10.1.1 According to the updated EM&A Manual, the programme of environmental site inspection shall be formulated by ET Leader. Weekly environmental site inspections were carried out to confirm the environmental performance.

10.2 FINDINGS / DEFICIENCIES DURING THE REPORTING PERIOD

10.2.1 In the Reporting Period, joint site inspections to evaluate the site environmental performance for the Project were carried out by the representatives of the SM, ET and the Contractor on **4th, 11th, 18th and 24th June 2026**. In addition, IEC carried out the joint site inspection on **11th June 2026**. No non-compliance was noted.

10.2.2 The findings / deficiencies observed during the weekly site inspection are listed in **Table 10-1**.

Table 10-1 Site Inspection and Observations

Date	Findings / Deficiencies	Follow-Up Status
4 th June 2026	- Soil and debris cumulated inside the u-channel should be cleaned. (Portion C1) - Wheel washing facilities should be provided at the designated site exit. (Portion C1) - Exposed surface should be covered with tarpaulin sheets to reduce dust impact. (Portion C1) - Enhance dust mitigation measures should be provided for breaking works. (Portion A1) - Drip tray should be provided for chemical storage on-site. (Portion A1) - Oil stain leakage on ground should be cleaned. (Portion A1) - Stockpile of loose materials storage on-site should be covered with tarpaulin sheets. (Portion F)	- The u-channel was cleaned. - The designated site exit have been closed. - Exposed surface was covered. - Dust mitigation measure was provided. - The chemical was removed. - Oil stain leakage was cleaned. - The storage area for bulk materials on site has been covered.
11 th June 2026	- Broken acoustic mat wrapped on breaker head should be replaced. (Portion A1) - Proper dust mitigation measures should be provided for exposed area to reduce dust impact. (Portion C1) - Drip tray should be provided for the generator. (Portion A1) - Proper maintenance should be provided for the wheel washing facilities to make sure the facilities is functional. (Portion A1)	- Acoustic mat was replaced. - Dust mitigation measure was provided. - The generator has been removed. - Wheel washing facility was provided.
18 th June 2026	Storm water cumulated at the access road should be drained ASAP to prevent flooding. (Portion C1)	The floodwater was cleared.

	- Storm water cumulated inside the DG storage area should be cleaned to prevent overflow into the public area. (Portion C1) - Soil and mud cumulated inside the nullah should be cleaned. (Portion B1a) - All site generated muddy water should be diverted to proper de-silting facilities prior discharge. (Portion A1) - Proper wheel washing facilities should be provided at designated site exit. Moreover, mud trace cumulated at site exit should be cleaned. (Portion B1a) - Housekeeping should be improved, dried cement cumulated on-site should be cleaned. (Portion B2) - Stagnant water cumulated inside drip tray should be cleaned. (Portion B2) - Stockpile of loose materials storage on-site should be covered with tarpaulin sheet to reduce dust impact. (Portion F)	- The floodwater was cleared. - The nullah was cleaned. - The mud and water was removed. - A washer hose was set up. The mud was cleaned up. - The dry cement was cleaned up. - Stagnant water was removed. - The storage area for bulk materials on site has been covered.
24 th June 2026	- Oil stain leakage on the ground should be cleaned. (Portion F) - Enhance dust mitigation measures should be provided for the haul road to reduce dust impact. (Portion B9) - Proper maintenance should be provided for de-silting facilities to make sure the de-silting facilities are functional. (Portion B1a) - Soil and mud cumulated inside the nullah should be cleaned (Portion B1a)	- Oil stain was cleaned. - Enhanced dust mitigation measure was provided. - De-silting facilities was improved. - Soil and mud was cleaned.

10.2.3 General housekeeping such as site tidiness and cleanliness should be maintained for all works areas. Furthermore, the Contractor was reminded to implement the Waste Management Plan of the Contract.

11 ENVIRONMENTAL COMPLAINTS AND NON-COMPLIANCES

11.1 ENVIRONMENTAL COMPLAINTS, SUMMONS AND PROSECUTIONS

- 11.1.1 There was no environmental prosecution or notification of summons received in the Reporting Period. However, one (1) environmental complaint was received by 1823 Hotline on 5 June 2026 regarding dust from Nim Wan Road and dust suspension matter along Nim Wan Road on 1 June 2026.
- 11.1.2 The investigation report (IR) has been submitted by ET and concluded that there is no evidence that the dust issue at Nim Wan Road was caused by the project, and that the complaint is therefore not Project related. The IR of the complaint is shown in *Appendix N*.
- 11.1.3 The statistical summary table of the environmental complaints, summons and prosecutions are presented in *Tables 11-1*. The complaint log for the Project is presented in *Appendix L*.

Table 11-1 Statistical for Environmental Complaints, Summons and Prosecutions

Reporting Period	Cumulative Statistics		
	Environmental Complaints	Environmental Summons	Environmental Prosecutions
June 2026	1	0	0
Accumulate of Project	5 + (2 [*])	0	0

Remarks: * complaint which is non-project related after investigation

11.2 OTHER ENVIRONMENTAL NON-COMPLIANCES

- 11.2.1 In addition, no emergency events related to violation of environmental legislation for illegal dumping and landfilling were received in the Reporting Period.

12 IMPLEMENTATION STATUS OF MITIGATION MEASURES

12.1 GENERAL REQUIREMENTS

- 12.1.1 The environmental mitigation measures that recommended in the EMIS in the EM&A Manual covered the issues of dust, noise, water and waste etc. and they are summarised presented in *Appendix M*.
- 12.1.2 The works under the Project shall be implementing the required environmental mitigation measures according to the EM&A Manual as subject to the site condition. Environmental mitigation measures generally implemented by the Contractor and the implementation status are shown in *Appendix M*.

12.2 TENTATIVE CONSTRUCTION ACTIVITIES IN THE COMING MONTH

- 12.2.1 According to information provided by the Contractor, the construction works under the Project in the next month are listed below:

Eastern Platform – Site Formation

- Soft Excavation
- Rock Excavation
- 132kV Substation Construction
- Blasting
- Installation of Monitoring Wells
- Leachate Liner Installation

Landfill Waste Filling Area (Phase I) - Site Formation

- Soft Excavation
- Rock Excavation
- Blasting

Crusher and Conveyor Belt System

- Rock Crushing
- Plant Installation
- Piling Works

Rising Main and Fresh Watermain Along Nim Wan Road

- Pipe Laying Works
- Construction of Pump House

Reclamation and Box Culverts

- Reclamation in DCM Area
- Box Culvert Construction

Marine Works

- Temporary Drainage Diversion
- Maintenance Dredging Work

Major Buildings in B10 & B9 (Service Bldg, Filtration Bldg, Bioreactor Bldg)

- BS Works & E&M Installation
- CLP Transformer Installation
- Footing Excavation
- RC Works

Weighbridge Reprovision/Modification Works

- Drainage, Utilities and Roadwork

Asbestos Removal Works

- Asbestos removal

12.3 KEY ISSUES FOR THE COMING MONTH

12.3.1 Key issues for the coming month include the following:

- Implementation of control measures for rainstorm / adverse weather;
- Regular clearance of stagnant water;
- Implementation of dust suppression measures at all times;
- Implementation of permanent/temporary drainage system and control measures for the surface runoff;
- Implementation of dust suppression measures for the dry/loose/exposure soil surface/dusty material;
- Implementation of control measures to avoid disposal of empty engine oil containers within site area;
- Ensure dust suppression measures are implemented properly;
- Regular maintenance of sediment catch-pits and silt removal facilities;
- Management of chemical wastes;
- Implementation of control measures to avoid discharge of site effluent to the nearby stream;
- Implementation of waste management; and
- Implementation of construction noise preventative control measures.

14 CONCLUSIONS AND RECOMMENDATIONS

14.1 CONCLUSIONS

- 14.1.1 This is the 27th Monthly EM&A Report presenting the monitoring results and inspection findings for the Project for the period from 1st to 30th June 2026.
- 14.1.2 In this Reporting Period, no 1-hour and 24-hour TSP of air quality monitoring result that triggered the Action or Limit Levels was recorded. No corrective action was required.
- 14.1.3 In this Reporting Period, no noise complaint (which is an Action Level exceedance) was received and no construction noise measurement result triggered the Limit Level was recorded in this Reporting Month. Moreover, all construction works during restricted hours were followed the CNP requirement. Therefore, no corrective action was issued.
- 14.1.4 In this Reporting Period, no surface water quality monitoring result that triggered the Action or Limit Levels was recorded. No corrective action was required.
- 14.1.5 The LFG monitoring was conducted for excavation work in June 2026. No exceedance of Limit Levels of LFG was recorded during the reporting period. Moreover, baseline LFG monitoring at landfill gas well was carried out in this reporting month.
- 14.1.6 For landscape and visual, implementation of mitigation measures during construction phase of the Project has been monitored through regular site inspection/ audit.
- 14.1.7 In the Reporting Period, one (1) environmental complaint was received by 1823 hotline on 5 June 2026 regarding dust from Nim Wan Road and dust suspension matter along Nim Wan Road on 1 June 2026. The investigation report (IR) has been submitted by ET and concluded that there is no evidence that the dust issue at Nim Wan Road was caused by the project, and that the complaint is therefore not Project related.
- 14.1.8 In addition, no emergency events related to violation of environmental legislation for illegal dumping and landfilling were received.
- 14.1.9 In the Reporting Period, weekly joint site inspection to evaluate the site environmental performance had been carried out by the representatives of the SM, ET and the Contractor. No non-compliance was noted during the site inspection. In addition, IEC carried out the joint site inspections on 11th June 2026.

14.2 RECOMMENDATIONS

- 14.2.1 Water quality mitigation measures shall be fully implemented in accordance with the Implementation Schedule for Environmental Mitigation Measures of the updated EM&A Manual.
- 14.2.2 In addition, the Contractor should fully implement the recommended air quality mitigation measures to minimize the impact of construction dust as far as practicable.
- 14.2.3 Construction noise would be a key environmental issue during construction work of the Project. In accordance with the EP, a noise bund of 3.5m tall has been constructed along the north eastern seafront of the existing landfill as shown in Figure 2 of the EP prior to the commencement of construction. It is reminded that the noise bund shall be properly maintained during the construction, operation and restoration of the Project.

- 14.2.4 All other mitigation measures recommended in the EMIS of the EM&A Manual should be properly implemented and maintained as far as practicable.

Appendix A

Location Plan of Enhanced Scheme

of WENTX Landfill Extension



- LEGEND**
- WENT LANDFILL EXTENSION (WENTX) BOUNDARY
 - WENTX WASTE BOUNDARY
 - LANDFILL INFRASTRUCTURE FOR WENTX
 - WENT LANDFILL BOUNDARY
 - TREE PLANTING BUFFER

Project title
**Contract No. EP/SP/186/21
West New Territories
Landfill Extension**

Drawing title
**GENERAL PLAN
OF ENHANCED SCHEME**


COPYRIGHT RESERVED

0 50 100 150 200 250
METRES

Appendix B

Project Organization and the key personal contact

Flow chart showing Line of Communication and Working Relationship

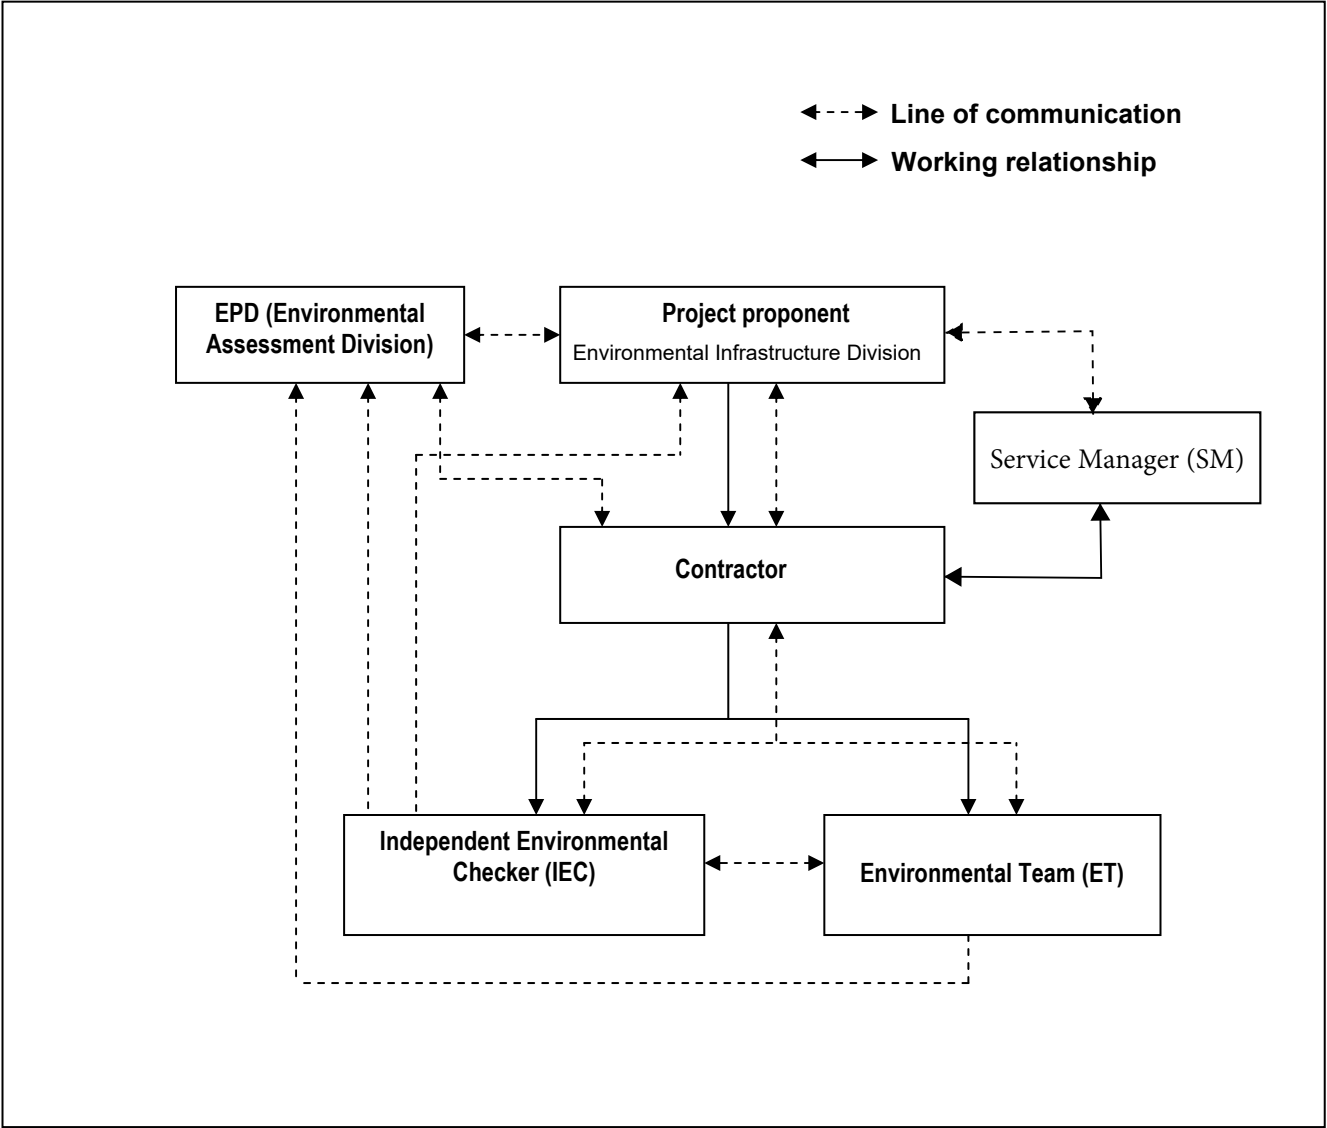

Contact Details of Key Personnel

Organization	Project Role	Name of Key Staff	Tel No.	Fax No.
HKRRP	Project Manager	Mr. Victor Wu	2862 5013	--
HKRRP	Environmental Manager	Mr. Kenneth Lau	9315 4944	--
ANWR	Independent Environmental Checker	Mr. James Choi	2618 2831	3007 8648
AUES	Environmental Team Leader	Mr. Tam Tak Wing	2959 6059	2959 6079

Legend:

ANWR (IEC) – ANewR Consulting Limited

AUES (ET) – Action-United Environmental Services & Consulting

HKRRP - (the Contractor) – Hong Kong Resources Recovery Park

Appendix C


3-month Rolling Construction Programme

Construction Programme (July 2026 to October 2026)
West New Territories Landfill Extension (WENTX)

Construction Activities	2026			
	Jul	Aug	Sep	Oct
Phase 1 - Site Formation				
- Soft Excavation				
- Rock Excavation				
- 132kV Power Substation Works				
- Blasting				
- Installation of Monitoring Wells				
- Leachate Liner Installation				
Landfill Waste Filling Area (Phase I) - Site Formation				
- Soft Excavation				
- Rock Excavation				
- Blasting				
Eastern Platform, Rock Crusher and Conveyor Belt System				
- Rock Crushing				
- Plant Installation				
- Piling Works				
Rising Main and Fresh Watermain Along Nim Wan Road				
- Pipe Laying Works				
Reclamation and Box Culverts				
- Reclamation in DCM Area				
- Box Culvert Construction				
Marine Works				
- Construction of Vertical Seawall				
- Temporary Drainage Diversion				
- Maintenance Dredging Work				
Major Buildings in B10 & B9				
- BS Works & E&M Installation				
- CLP Transformer Installation				
- Foundation				
- RC works				
Weighbridge Reprovision/Modification Works				
- Drainage, Utilities, and Roadwork				
Asbestos Removal Works				
- Asbestos removal				

Appendix D

Monitoring Locations

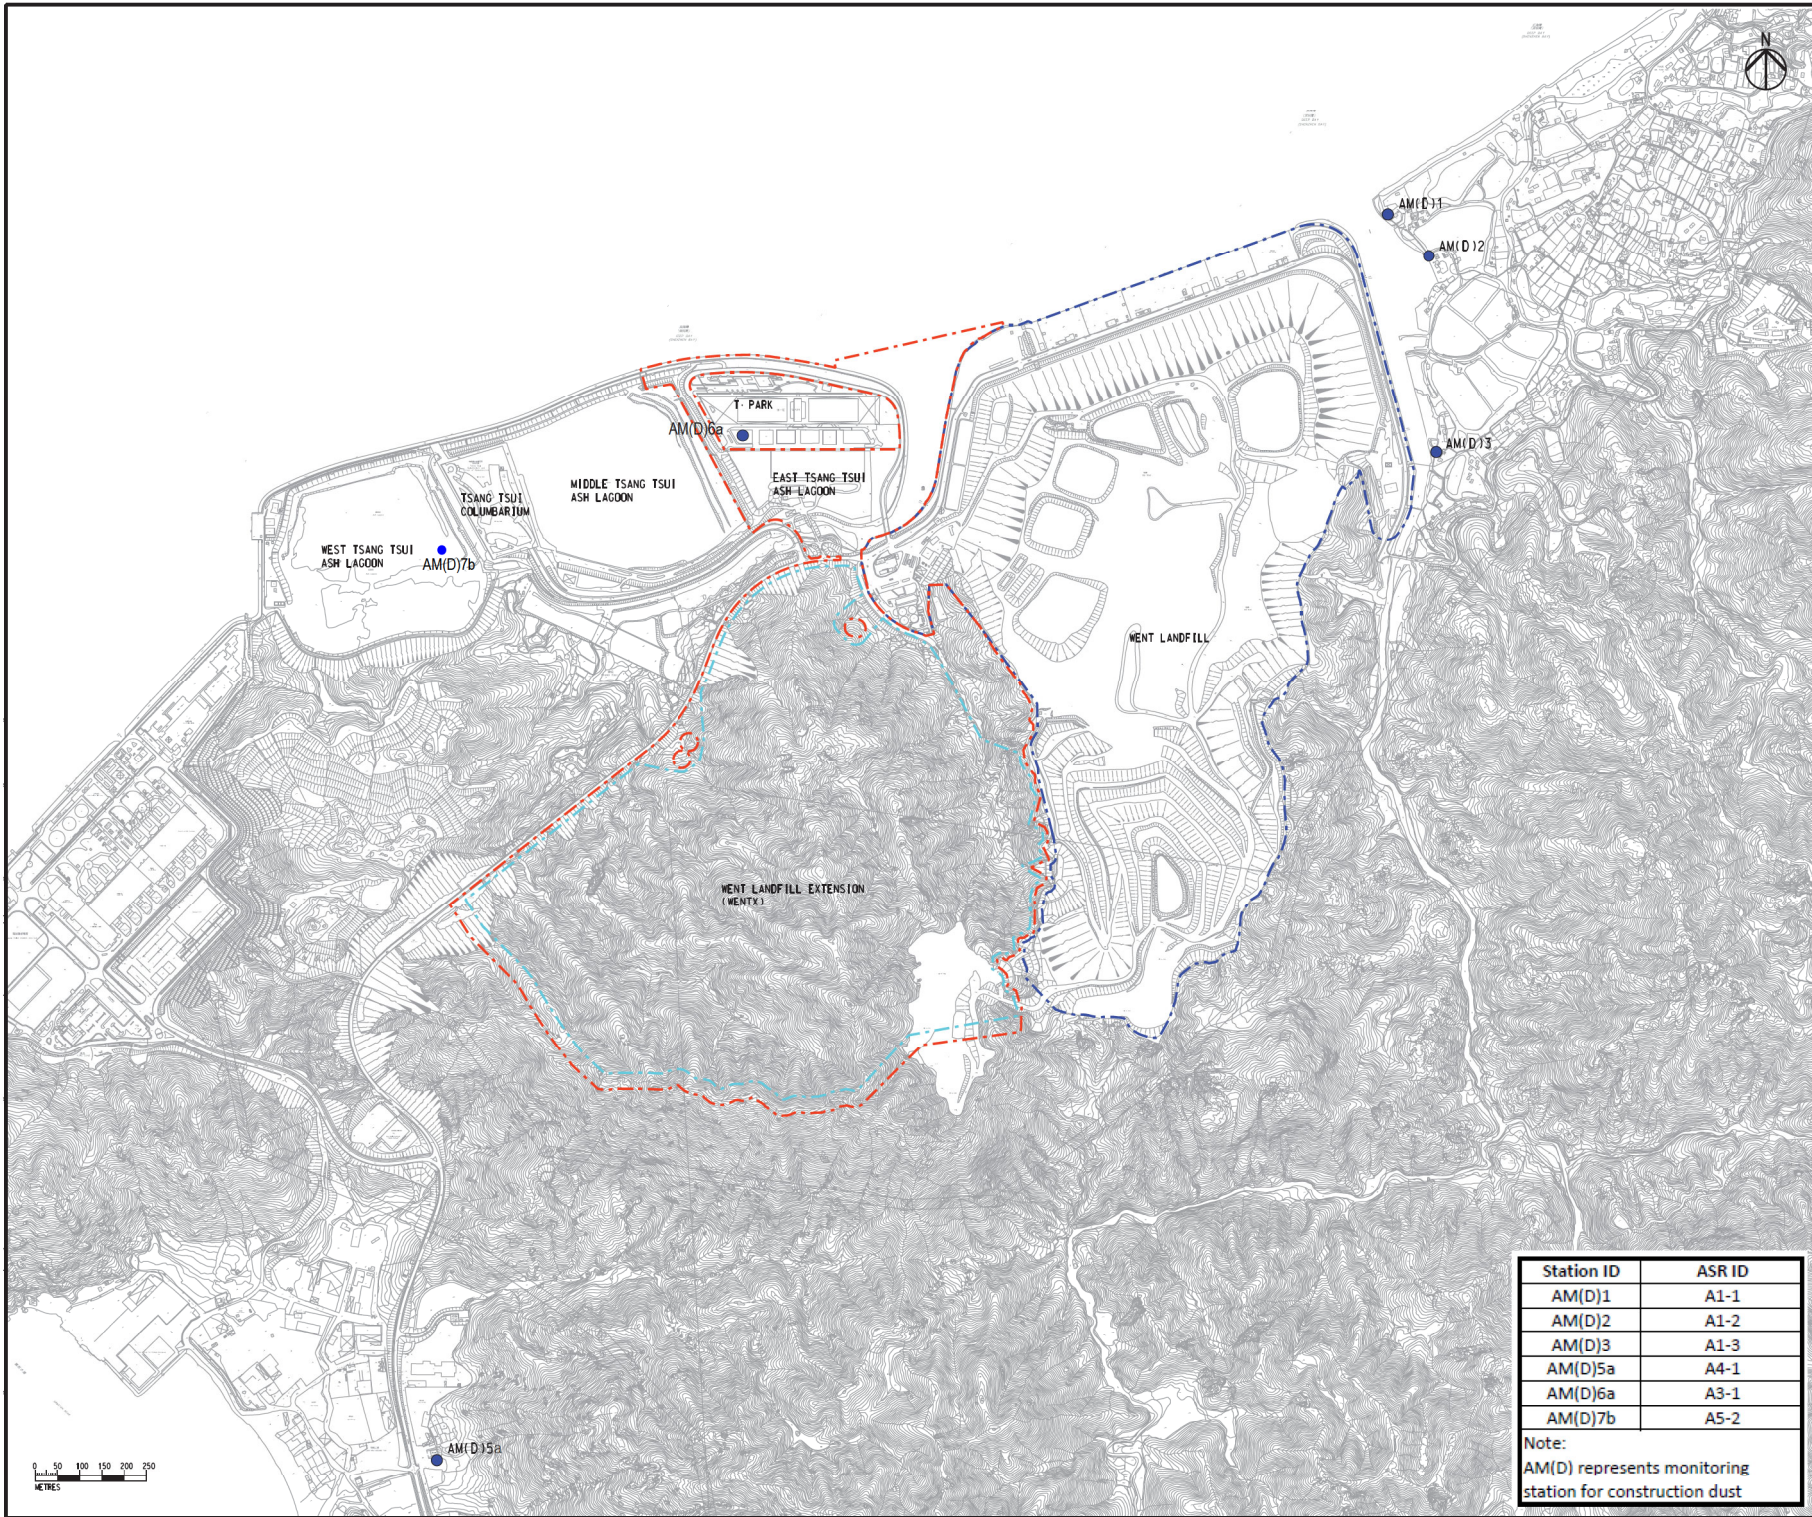

- LEGEND**
- WENT LANDFILL EXTENSION (WENTX) BOUNDARY
 - WENTX WASTE BOUNDARY
 - WENT LANDFILL BOUNDARY
 - AIR QUALITY MONITORING LOCATIONS

Consultant


Project title
Contract No. EP/SP/186/21
West New Territories Landfill Extension

Drawing title
LOCATIONS OF AIR QUALITY MONITORING STATIONS

COPYRIGHT RESERVED

Station ID	ASR ID
AM(D)1	A1-1
AM(D)2	A1-2
AM(D)3	A1-3
AM(D)5a	A4-1
AM(D)6a	A3-1
AM(D)7b	A5-2

Note:
AM(D) represents monitoring station for construction dust

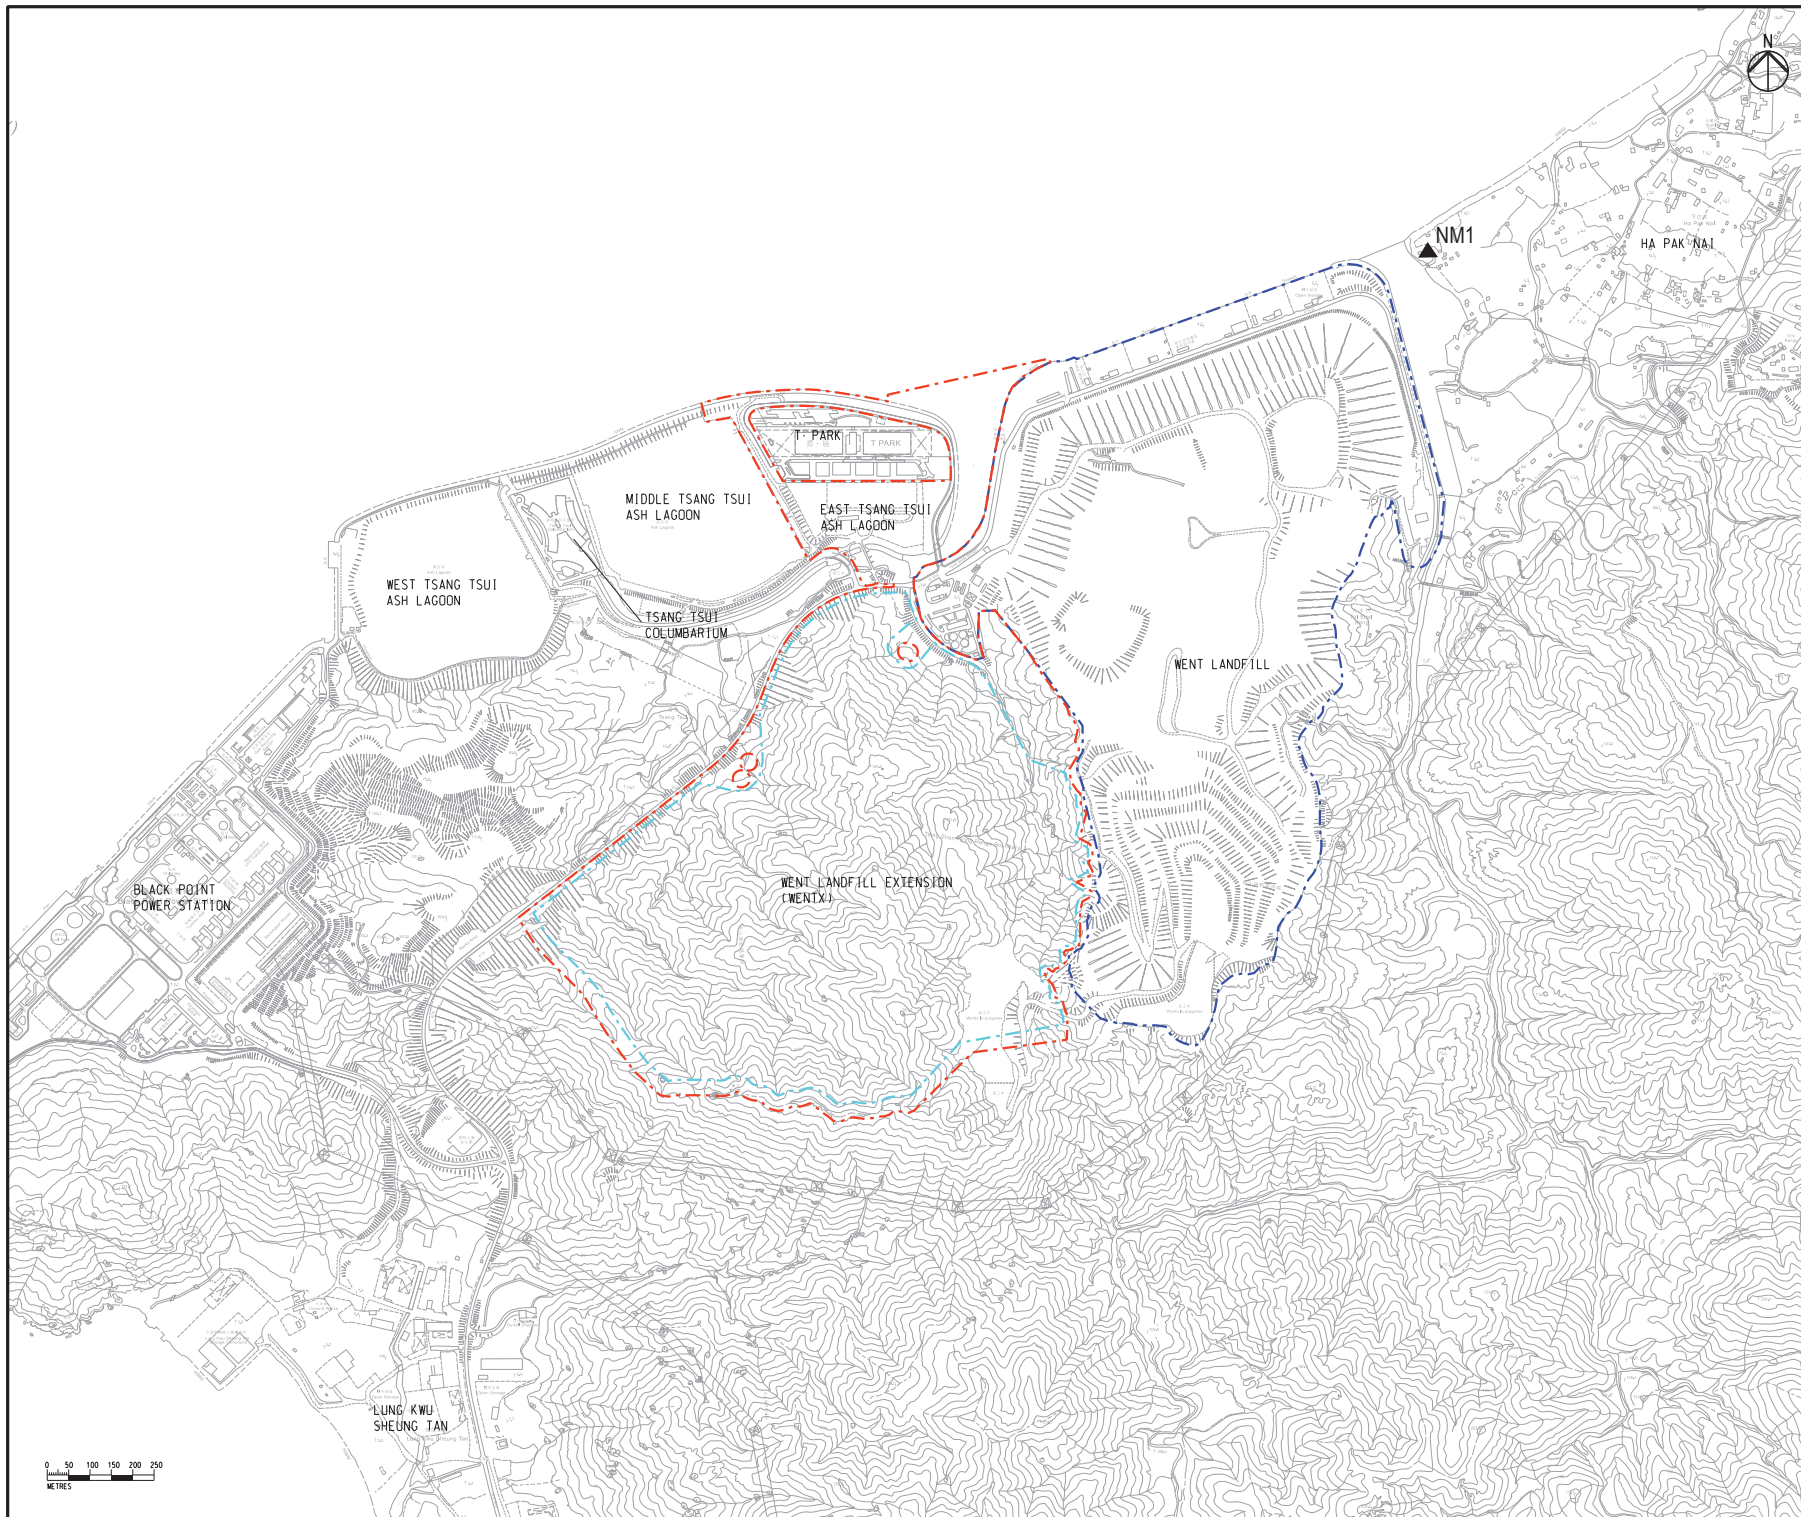

- LEGEND
- WENT LANDFILL EXTENSION (WENTX) BOUNDARY
 - WENTX WASTE BOUNDARY
 - WENT LANDFILL BOUNDARY
 - ▲ NOISE MONITORING LOCATION


Consultant

Contract No. EP/SP/186/21
West New Territories Landfill
Extension

Drawing title

NOISE MONITORING LOCATION

0 50 100 150 200 250
METRES

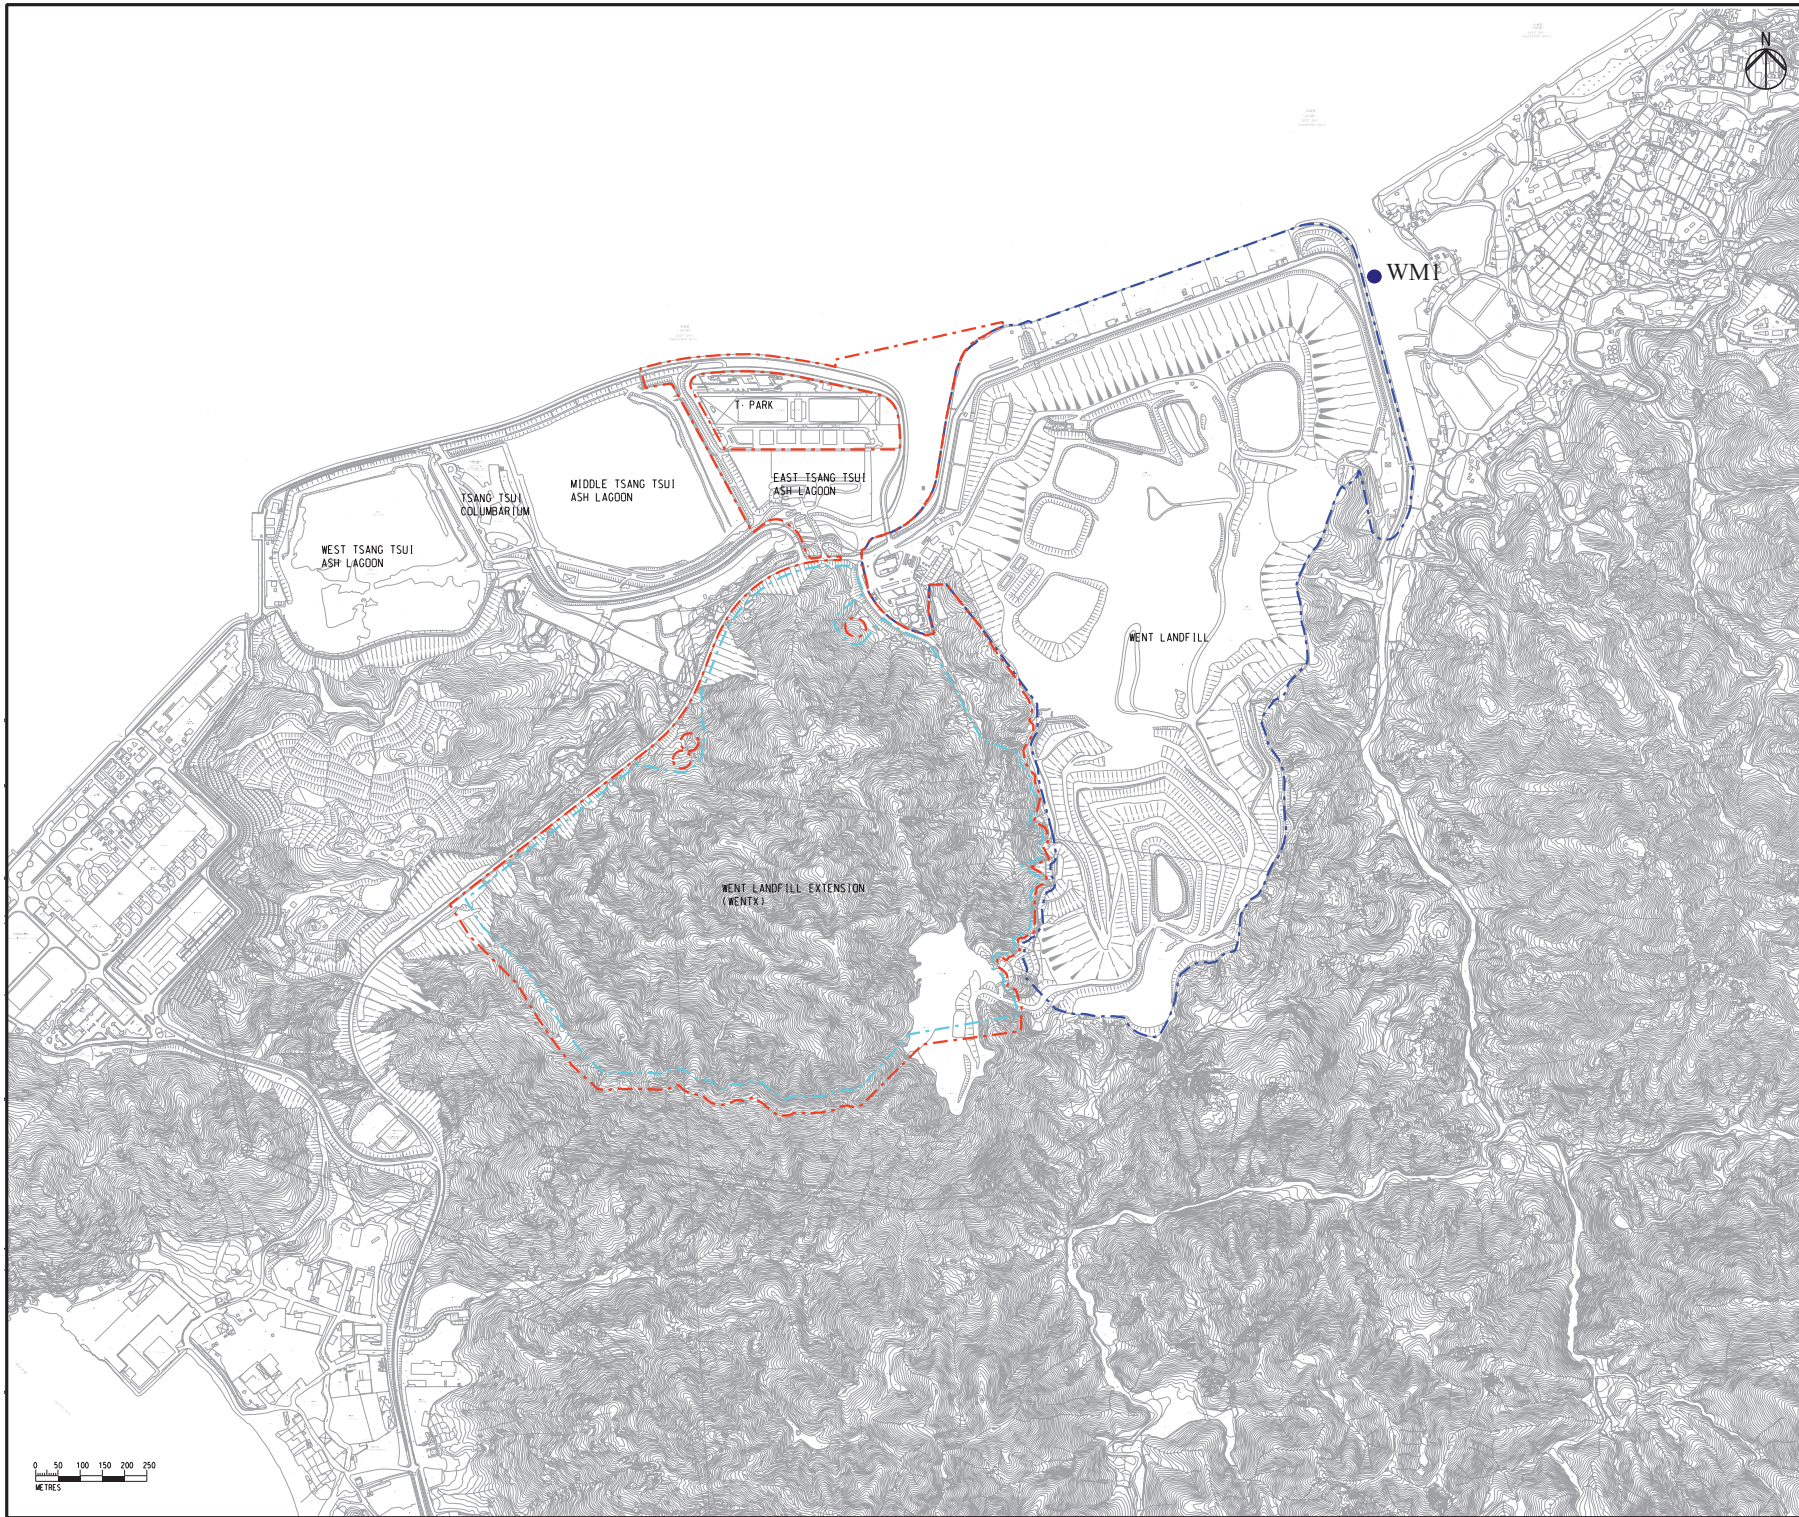

- LEGEND
- WENT LANDFILL EXTENSION (WENTX) BOUNDARY
 - WENTX WASTE BOUNDARY
 - WENT LANDFILL BOUNDARY
 - SURFACE WATER MONITORING STATION

Consultant
Project title
Contract No. EP/SP/186/21 West New Territories Landfill Extension
Drawing title
SURFACE WATER MONITORING STATION

COPYRIGHT RESERVED

0 50 100 150 200 250
METRES

Appendix E

Calibration Certificates

Appendix E1

Calibration Certificates for

Air Quality Monitoring Equipment

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai
 Location ID : AM(D)1
 Model: TISCH High Volume Air Sampler TE-5170

Date of Calibration: 13 Apr 26
 Next Calibration Date: 13 Jun 26
 Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1011.1	Corrected Pressure (mm Hg)	758.325
Temperature (°C)	27.1	Temperature (K)	300

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13603
Model->	5025A	Qstd Intercept ->	-0.04992
Serial # ->	1941		

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.10	6.10	12.2	1.651	53	52.57	Slope = 28.5952
13	4.80	4.80	9.6	1.467	46	45.63	Intercept = 4.5778
10	3.50	3.50	7.0	1.256	41	40.67	Corr. coeff. = 0.9964
7	2.40	2.40	4.8	1.044	34	33.72	
5	1.60	1.60	3.2	0.857	30	29.76	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

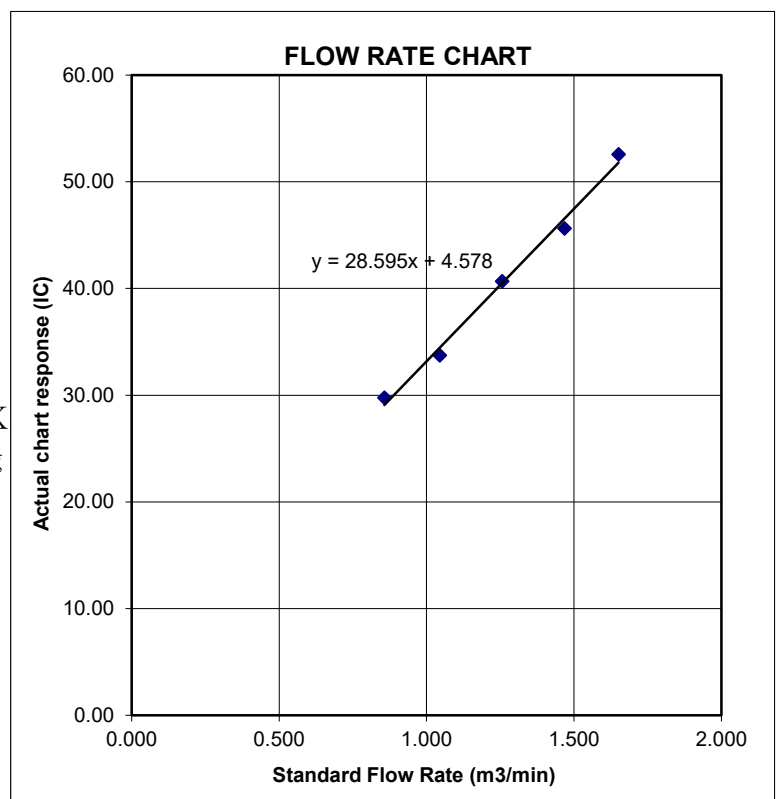

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai Date of Calibration: 13 Apr 26
 Location ID : AM(D)2 Next Calibration Date: 13 Jun 26
 Model: TISCH High Volume Air Sampler TE-5170 Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1011.1	Corrected Pressure (mm Hg)	758.325
Temperature (°C)	27.1	Temperature (K)	300

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13603
Model->	5025A	Qstd Intercept ->	-0.04992
Serial # ->	1941		

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.20	6.20	12.4	1.664	52	51.58	Slope = 30.4030
13	4.90	4.90	9.8	1.482	46	45.63	Intercept = 1.0588
10	3.60	3.60	7.2	1.274	41	40.67	Corr. coeff. = 0.9985
7	2.70	2.70	5.4	1.106	35	34.72	
5	1.60	1.60	3.2	0.857	27	26.78	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

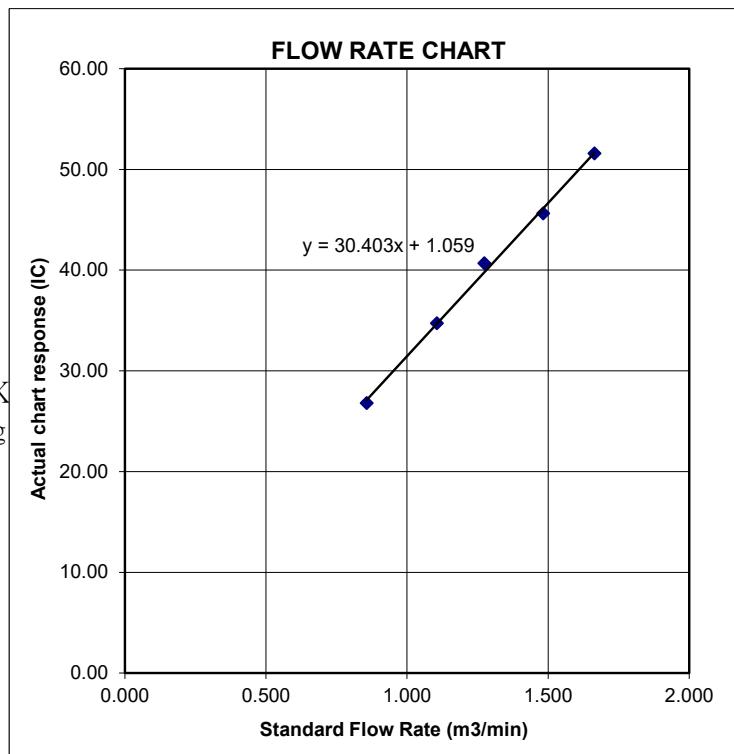

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai Date of Calibration: 13 Apr 26
 Location ID : AM(D)3 Next Calibration Date: 13 Jun 26
 Model: TISCH High Volume Air Sampler TE-5170 Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1011.1	Corrected Pressure (mm Hg)	758.325
Temperature (°C)	27.1	Temperature (K)	300

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13603
Model->	5025A	Qstd Intercept ->	-0.04992
Serial # ->	1941		

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.678	54	53.56	Slope = 28.4151
13	5.10	5.10	10.2	1.512	49	48.60	Intercept = 5.5119
10	3.90	3.90	7.8	1.325	43	42.65	Corr. coeff. = 0.9983
7	2.60	2.60	5.2	1.086	36	35.71	
5	1.50	1.50	3.0	0.831	30	29.76	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

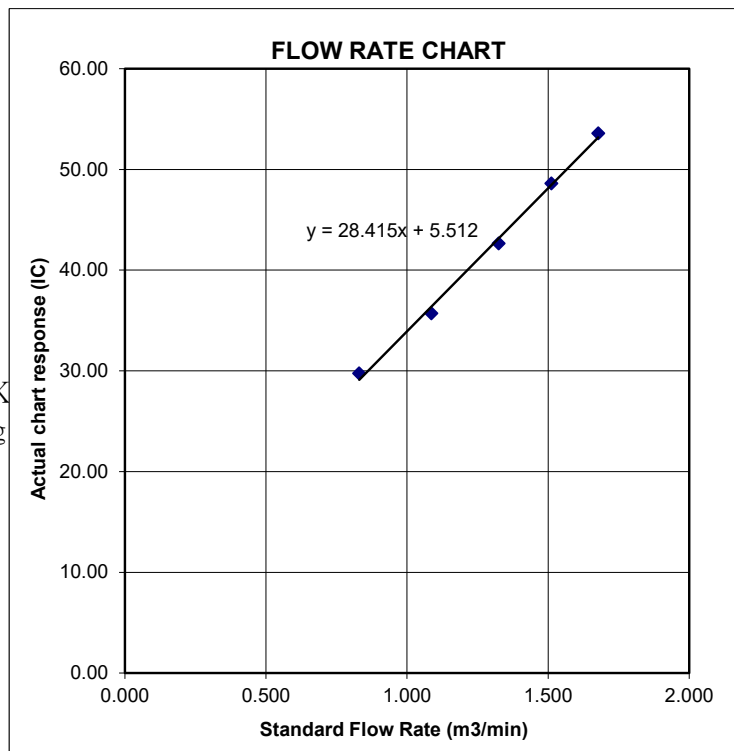

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Lung Kwu Sheung Tan

Date of Calibration: 13 Apr 26

Location ID : AM(D)5a

Next Calibration Date: 13 Jun 26

Model: TISCH High Volume Air Sampler TE-5170

Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)

1011.1

Corrected Pressure (mm Hg)

758.325

Temperature (°C)

27.1

Temperature (K)

300

CALIBRATION ORIFICE

Make-> TISCH

Qstd Slope ->

2.13603

Model-> 5025A

Qstd Intercept ->

-0.04992

Serial # -> 1941

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.20	6.20	12.4	1.664	52	51.58	Slope = 28.2897
13	4.60	4.60	9.2	1.437	46	45.63	Intercept = 4.9898
10	3.60	3.60	7.2	1.274	42	41.66	Corr. coeff. = 0.9978
7	2.50	2.50	5.0	1.065	36	35.71	
5	1.50	1.50	3.0	0.831	28	27.77	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

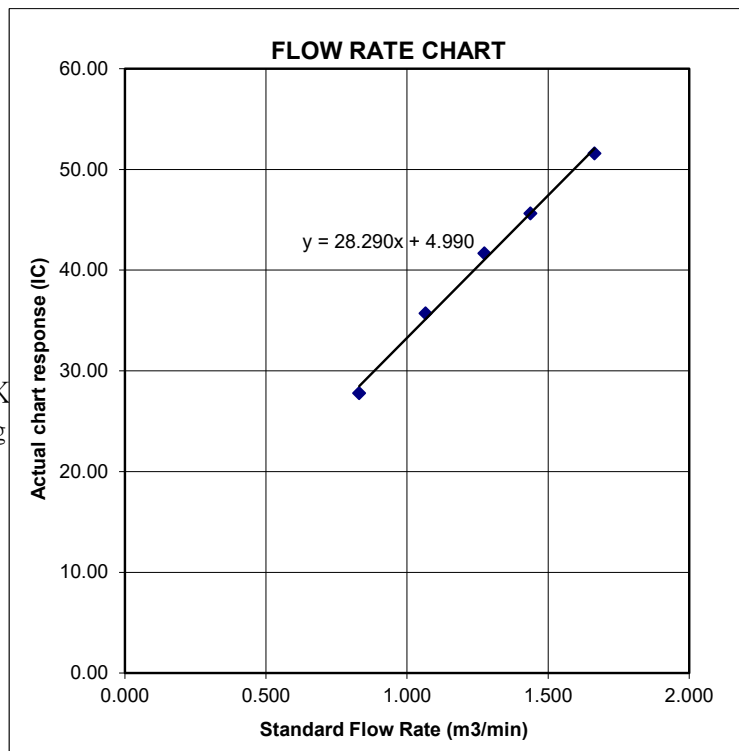

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Roof Top of T-Park Workshop	Date of Calibration: 13 Apr 26
Location ID : AM(D)6a	Next Calibration Date: 13 Jun 26
Model: TISCH High Volume Air Sampler TE-5170	Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1011.1	Corrected Pressure (mm Hg)	758.325
Temperature (°C)	27.1	Temperature (K)	300

CALIBRATION ORIFICE

Make-> TISCH	Qstd Slope -> 2.13603
Model-> 5025A	Qstd Intercept -> -0.04992
Serial # -> 1941	

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.20	6.20	12.4	1.664	52	51.58	Slope = 28.3821
13	5.30	5.30	10.6	1.541	47	46.62	Intercept = 3.3441
10	4.00	4.00	8.0	1.341	41	40.67	Corr. coeff. = 0.9970
7	2.60	2.60	5.2	1.086	34	33.72	
5	1.40	1.40	2.8	0.803	27	26.78	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

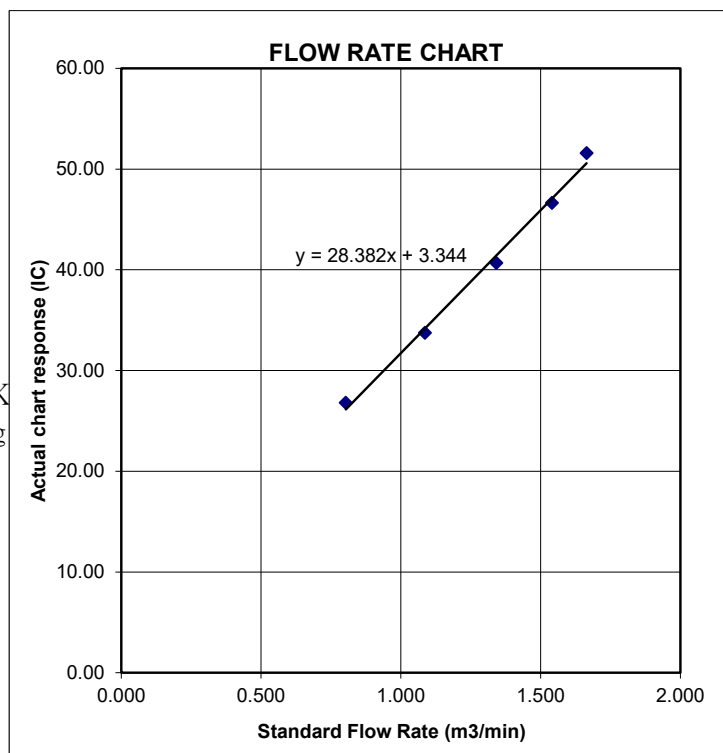

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Site Boundary of West Ash Lagoon
 Location ID : AM(D)7b
 Model: TISCH High Volume Air Sampler TE-5170

Date of Calibration: 13 Apr 26
 Next Calibration Date: 13 Jun 26
 Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa) 1011.1
 Temperature (°C) 27.1

Corrected Pressure (mm Hg) 758.325
 Temperature (K) 300

CALIBRATION ORIFICE

Make-> TISCH
 Model-> 5025A
 Serial # -> 1941

Qstd Slope -> 2.13603
 Qstd Intercept -> -0.04992

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.678	52	51.58	Slope = 26.9071 Intercept = 5.5857 Corr. coeff. = 0.9966
13	5.00	5.00	10.0	1.497	46	45.63	
10	3.80	3.80	7.6	1.308	40	39.68	
7	2.60	2.60	5.2	1.086	35	34.72	
5	1.40	1.40	2.8	0.803	28	27.77	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

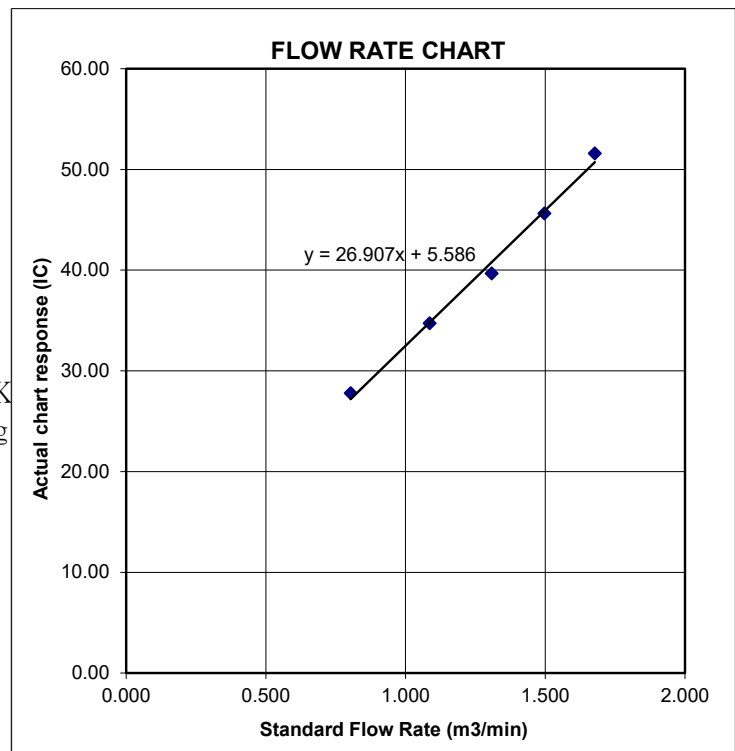

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai

Date of Calibration: 13 Jun 26

Location ID : AM(D)1

Next Calibration Date: 13 Aug 26

Model: TISCH High Volume Air Sampler TE-5170

Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)

1008.7

Temperature (°C)

27.8

Corrected Pressure (mm Hg)

756.525

Temperature (K)

301

CALIBRATION ORIFICE

Make-> TISCH

Model-> 5025A

Serial # -> 1941

Qstd Slope ->

2.13603

Qstd Intercept ->

-0.04992

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.00	6.00	12.0	1.634	53	52.39	Slope = 28.9435
13	4.70	4.70	9.4	1.449	46	45.47	Intercept = 4.1254
10	3.50	3.50	7.0	1.253	40	39.54	Corr. coeff. = 0.9957
7	2.50	2.50	5.0	1.063	35	34.59	
5	1.60	1.60	3.2	0.855	30	29.65	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I)[\text{Sqrt}(298/Tav)(Pav/760)]-b)$$

m = sampler slope


b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

FLOW RATE CHART

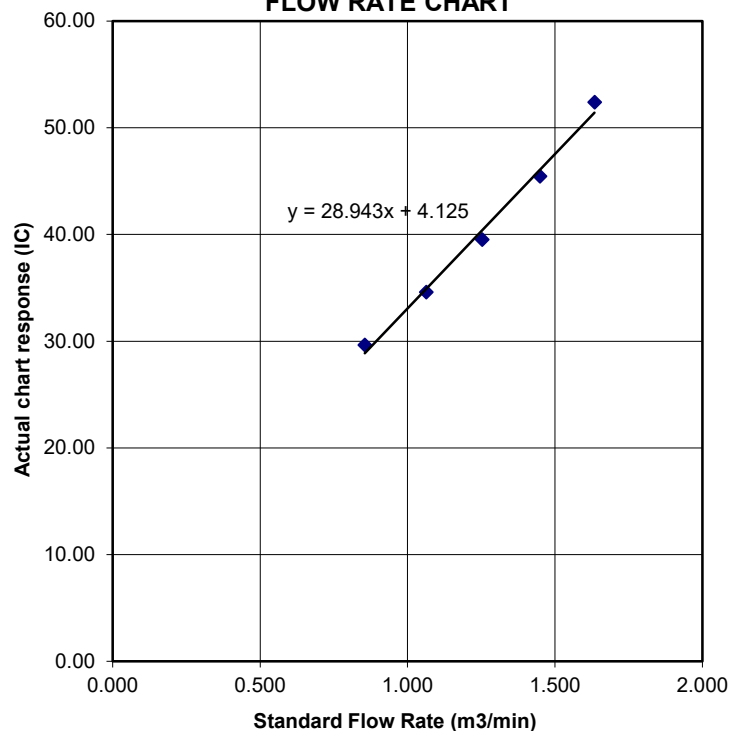

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai

Date of Calibration: 13 Jun 26

Location ID : AM(D)2

Next Calibration Date: 13 Aug 26

Model: TISCH High Volume Air Sampler TE-5170

Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)

1008.7

Corrected Pressure (mm Hg)

756.525

Temperature (°C)

27.8

Temperature (K)

301

CALIBRATION ORIFICE

Make-> TISCH

Qstd Slope ->

2.13603

Model-> 5025A

Qstd Intercept ->

-0.04992

Serial # -> 1941

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.10	6.10	12.2	1.647	52	51.40	Slope = 30.6705
13	4.90	4.90	9.8	1.479	46	45.47	Intercept = 0.7465
10	3.50	3.50	7.0	1.253	40	39.54	Corr. coeff. = 0.9986
7	2.60	2.60	5.2	1.084	35	34.59	
5	1.50	1.50	3.0	0.829	26	25.70	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

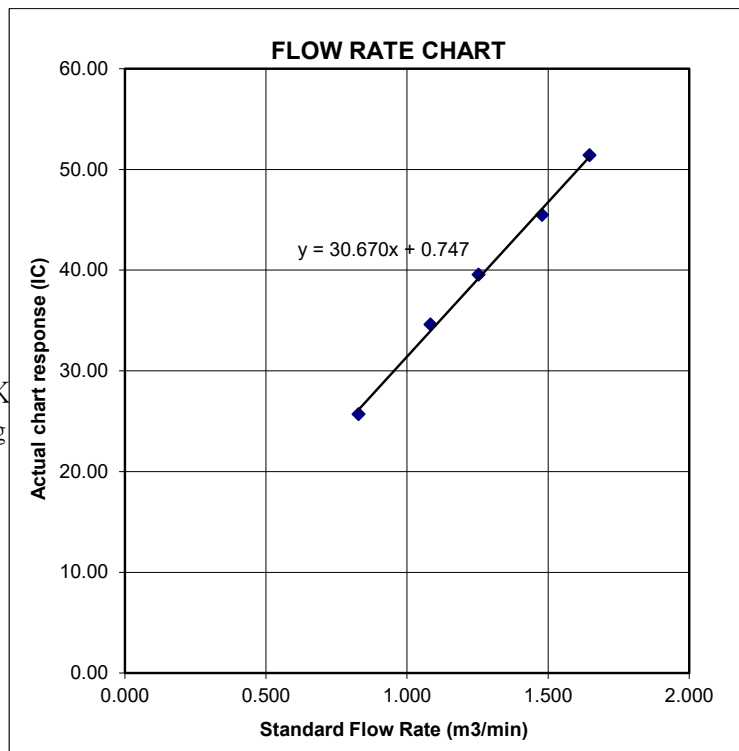

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai	Date of Calibration: 13 Jun 26
Location ID : AM(D)3	Next Calibration Date: 13 Aug 26
Model: TISCH High Volume Air Sampler TE-5170	Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1008.7	Corrected Pressure (mm Hg)	756.525
Temperature (°C)	27.8	Temperature (K)	301

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13603
Model->	5025A	Qstd Intercept ->	-0.04992
Serial # ->	1941		

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.20	6.20	12.4	1.660	53	52.39	Slope = 28.2079 Intercept = 4.7688 Corr. coeff. = 0.9978
13	5.00	5.00	10.0	1.494	47	46.46	
10	3.90	3.90	7.8	1.322	42	41.51	
7	2.70	2.70	5.4	1.104	36	35.58	
5	1.50	1.50	3.0	0.829	29	28.66	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

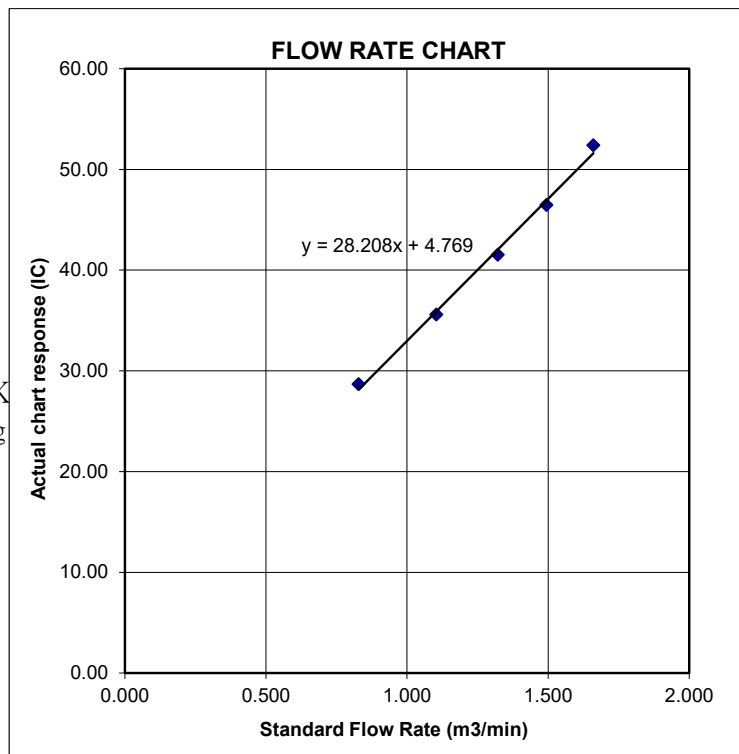

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Lung Kwu Sheung Tan

Date of Calibration: 13 Jun 26

Location ID : AM(D)5a

Next Calibration Date: 13 Aug 26

Model: TISCH High Volume Air Sampler TE-5170

Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)

1008.7

Corrected Pressure (mm Hg)

756.525

Temperature (°C)

27.8

Temperature (K)

301

CALIBRATION ORIFICE

Make-> TISCH

Qstd Slope ->

2.13603

Model-> 5025A

Qstd Intercept ->

-0.04992

Serial # -> 1941

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.10	6.10	12.2	1.647	53	52.39	Slope = 29.1938
13	4.60	4.60	9.2	1.434	48	47.44	Intercept = 4.6932
10	3.50	3.50	7.0	1.253	41	40.53	Corr. coeff. = 0.9974
7	2.40	2.40	4.8	1.042	36	35.58	
5	1.50	1.50	3.0	0.829	29	28.66	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

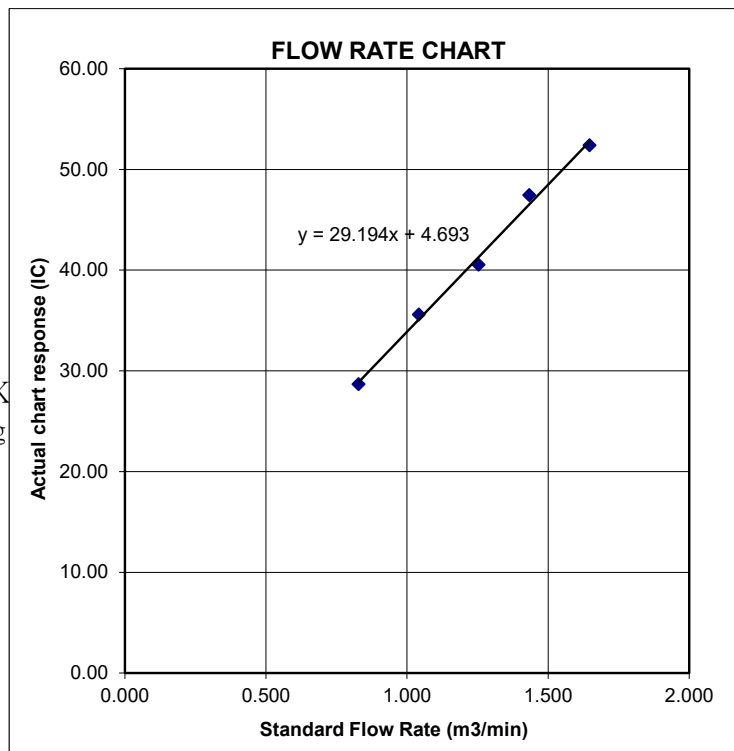

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Roof Top of T-Park Workshop

Date of Calibration: 13 Jun 26

Location ID : AM(D)6a

Next Calibration Date: 13 Aug 26

Model: TISCH High Volume Air Sampler TE-5170

Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)

1008.7

Corrected Pressure (mm Hg)

756.525

Temperature (°C)

27.8

Temperature (K)

301

CALIBRATION ORIFICE

Make-> TISCH

Qstd Slope ->

2.13603

Model-> 5025A

Qstd Intercept ->

-0.04992

Serial # -> 1941

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.674	52	51.40	Slope = 28.9561
13	5.30	5.30	10.6	1.537	48	47.44	Intercept = 2.7123
10	4.00	4.00	8.0	1.338	41	40.53	Corr. coeff. = 0.9984
7	2.60	2.60	5.2	1.084	35	34.59	
5	1.50	1.50	3.0	0.829	27	26.69	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

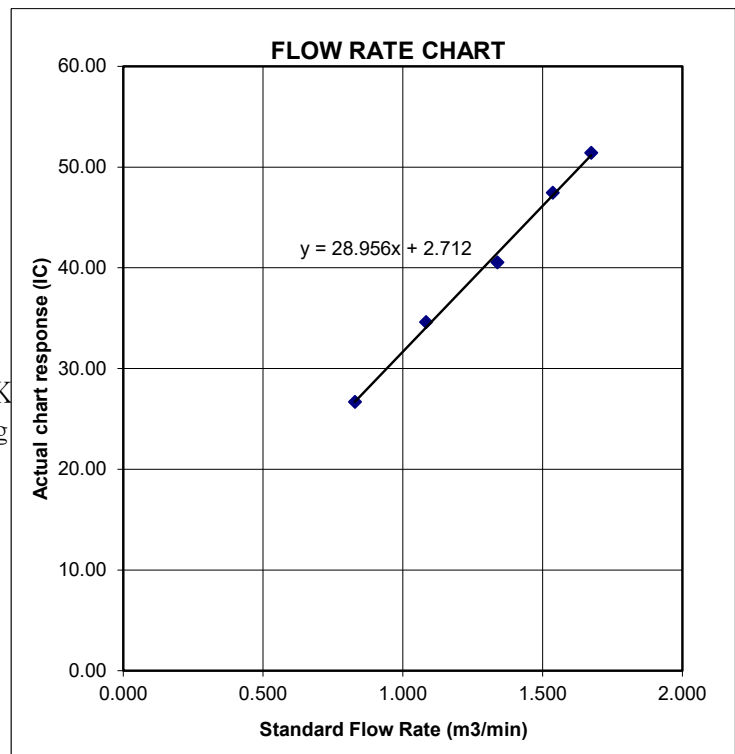

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Site Boundary of West Ash Lagoon	Date of Calibration: 13 Jun 26
Location ID : AM(D)7b	Next Calibration Date: 13 Aug 26
Model: TISCH High Volume Air Sampler TE-5170	Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1008.7	Corrected Pressure (mm Hg)	756.525
Temperature (°C)	27.8	Temperature (K)	301

CALIBRATION ORIFICE

Make-> TISCH	Qstd Slope ->
Model-> 5025A	Qstd Intercept ->
Serial # -> 1941	

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.674	53	52.39	Slope = 29.0140
13	5.00	5.00	10.0	1.494	47	46.46	Intercept = 3.1835
10	3.90	3.90	7.8	1.322	41	40.53	Corr. coeff. = 0.9978
7	2.60	2.60	5.2	1.084	35	34.59	
5	1.50	1.50	3.0	0.829	28	27.68	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

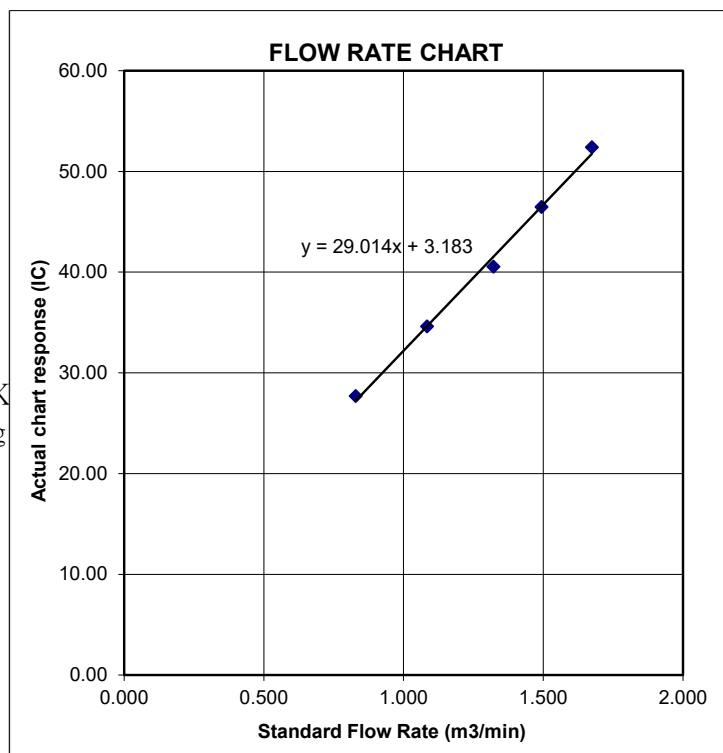

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 8, 2025 Rootsmeter S/N: 438320 Ta: 294 °K
Operator: Jim Tisch Pa: 755.7 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 1941

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4570	3.2	2.00
2	3	4	1	1.0380	6.4	4.00
3	5	6	1	0.9290	7.9	5.00
4	7	8	1	0.8850	8.8	5.50
5	9	10	1	0.7320	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
1.0035	0.6888	1.4197	0.9958	0.6834	0.8821
0.9993	0.9627	2.0078	0.9915	0.9552	1.2475
0.9973	1.0735	2.2448	0.9895	1.0652	1.3948
0.9961	1.1255	2.3543	0.9884	1.1168	1.4628
0.9907	1.3535	2.8394	0.9831	1.3430	1.7642
QSTD	m=	2.13603	QA	m=	1.33754
	b=	-0.04992		b=	-0.03102
	r=	1.00000		r=	1.00000

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsmeter manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



SUB-CONTRACTING REPORT

CONTACT	: MR BEN TAM	WORK ORDER	: HK2616160
CLIENT	: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING		
ADDRESS	: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.	SUB-BATCH	: 1
		DATE RECEIVED	: 16-APR-2026
		DATE OF ISSUE	: 23-APR-2026
PROJECT	: Not Specified	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ---

General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to Action-United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F. Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2616160
SUB-BATCH : 1
CLIENT : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING
PROJECT : Not Specified



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2616160-001	S/N: 456659 (EQ116)	AIR	16-Apr-2026	S/N: 456659 (EQ116)

----- END OF REPORT -----

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
Manufacturer: Sibata LD-3B
Serial No. 456659
Equipment Ref: EQ116

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)
Location & Location ID: Ha Pak Nai
Equipment Ref: HVS 023 (TISCH Model TE-5170 S/N:1048)
Last Calibration Date: 13 February 2026

Equipment Verification Results:

Verification Date: 20 March 2026

Date	Duration	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m ³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
20-Mar-26	60.0 mins	10:20 ~ 11:20	21.5	1015.7	46.7	1173	19.6
20-Mar-26	61.2 mins	11:23 ~ 12:24	21.5	1015.7	52.6	1031	16.8
20-Mar-26	60.6 mins	12:27 ~ 13:28	21.5	1015.7	106.3	1987	32.8

Sensitivity Adjustment Scale Setting (Before Calibration) 679 (CPM)


Sensitivity Adjustment Scale Setting (After Calibration) 678 (CPM)

Linear Regression of Y or X

Slope (K-factor): 3.1757 (µg/m³)/CPM

Correlation Coefficient (R) 0.9829

Date of Issue 1 April 2026

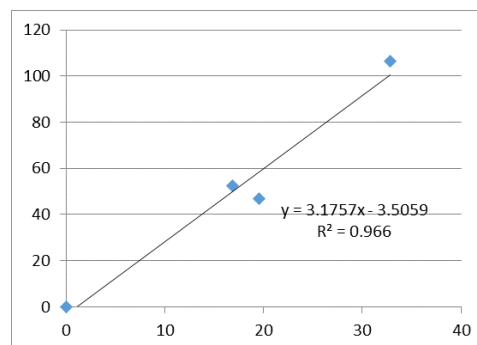

Remarks:

1. **Strong** Correlation ($R > 0.8$)
2. Factor 3.1757 (µg/m³)/CPM should be apply for TSP monitoring

*If $R < 0.5$, repair or re-verification is required for the equipment

Operator : Gary Ng Signature : [Signature] Date : 1 April 2026

QC Reviewer : Ben Tam Signature : [Signature] Date : 1 April 2026

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai
 Location ID : AM(D)3
 Model: TISCH High Volume Air Sampler TE-5170 (S/N:1048) Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1017.7	Corrected Pressure (mm Hg)	763.275
Temperature (°C)	20.2	Temperature (K)	293

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13603
Model->	5025A	Qstd Intercept ->	-0.04992
Serial # ->	1941		

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.702	55	56.02	Slope = 28.8418 Intercept = 6.1583 Corr. coeff. = 0.9981
13	5.20	5.20	10.4	1.549	49	49.91	
10	3.90	3.90	7.8	1.344	44	44.82	
7	2.70	2.70	5.4	1.123	38	38.71	
5	1.50	1.50	3.0	0.843	30	30.56	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

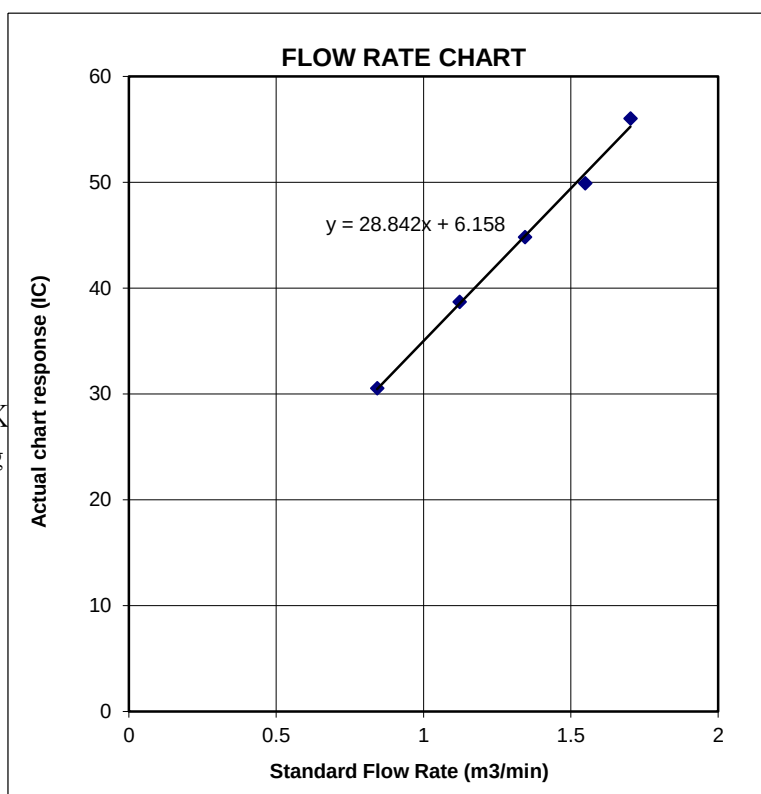

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 8, 2025 Rootsmeter S/N: 438320 Ta: 294 °K
Operator: Jim Tisch Pa: 755.7 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 1941

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4570	3.2	2.00
2	3	4	1	1.0380	6.4	4.00
3	5	6	1	0.9290	7.9	5.00
4	7	8	1	0.8850	8.8	5.50
5	9	10	1	0.7320	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
1.0035	0.6888	1.4197	0.9958	0.6834	0.8821
0.9993	0.9627	2.0078	0.9915	0.9552	1.2475
0.9973	1.0735	2.2448	0.9895	1.0652	1.3948
0.9961	1.1255	2.3543	0.9884	1.1168	1.4628
0.9907	1.3535	2.8394	0.9831	1.3430	1.7642
QSTD	m=	2.13603	QA	m=	1.33754
	b=	-0.04992		b=	-0.03102
	r=	1.00000		r=	1.00000

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsmeter manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



SUB-CONTRACTING REPORT

CONTACT	: MR BEN TAM	WORK ORDER	: HK2616162
CLIENT	: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING		
ADDRESS	: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.	SUB-BATCH	: 1
		DATE RECEIVED	: 16-APR-2026
		DATE OF ISSUE	: 23-APR-2026
PROJECT	: Not Specified	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ---

General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to Action-United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F. Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2616162
SUB-BATCH : 1
CLIENT : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING
PROJECT : Not Specified



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2616162-001	S/N: 456660 (EQ117)	AIR	16-Apr-2026	S/N: 456660 (EQ117)

----- END OF REPORT -----

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
Manufacturer: Sibata LD-3B
Serial No. 456660
Equipment Ref: EQ117

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)
Location & Location ID: Ha Pak Nai
Equipment Ref: HVS 023 (TISCH Model TE-5170 S/N:1048)
Last Calibration Date: 13 February 2026

Equipment Verification Results:

Verification Date: 20 March 2026

Date	Duration	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m ³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
20-Mar-26	60.0 mins	10:20 ~ 11:20	21.5	1015.7	46.7	1936	32.3
20-Mar-26	61.2 mins	11:23 ~ 12:24	21.5	1015.7	52.6	1950	31.9
20-Mar-26	60.6 mins	12:27 ~ 13:28	21.5	1015.7	106.3	3924	64.8

Sensitivity Adjustment Scale Setting (Before Calibration) 602 (CPM)


Sensitivity Adjustment Scale Setting (After Calibration) 602 (CPM)

Linear Regression of Y or X

Slope (K-factor): 1.6421 (µg/m³)/CPM

Correlation Coefficient (R) 0.9973

Date of Issue 1 April 2026

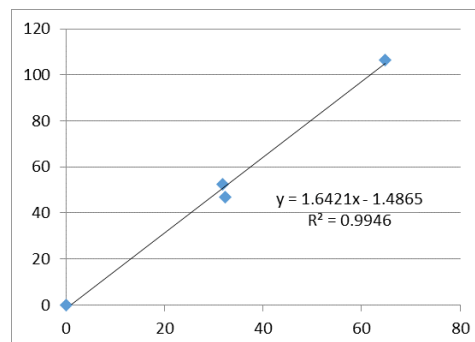

Remarks:

1. **Strong** Correlation ($R > 0.8$)
2. Factor 1.6421 (µg/m³)/CPM should be apply for TSP monitoring

*If $R < 0.5$, repair or re-verification is required for the equipment

Operator : Gary Ng Signature : [Signature] Date : 1 April 2026

QC Reviewer : Ben Tam Signature : [Signature] Date : 1 April 2026

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai
 Location ID : AM(D)3
 Model: TISCH High Volume Air Sampler TE-5170 (S/N:1048) Technician: Dicky Chan

CONDITIONS

Sea Level Pressure (hPa)	1017.7	Corrected Pressure (mm Hg)	763.275
Temperature (°C)	20.2	Temperature (K)	293

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.13603
Model->	5025A	Qstd Intercept ->	-0.04992
Serial # ->	1941		

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.702	55	56.02	Slope = 28.8418 Intercept = 6.1583 Corr. coeff. = 0.9981
13	5.20	5.20	10.4	1.549	49	49.91	
10	3.90	3.90	7.8	1.344	44	44.82	
7	2.70	2.70	5.4	1.123	38	38.71	
5	1.50	1.50	3.0	0.843	30	30.56	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

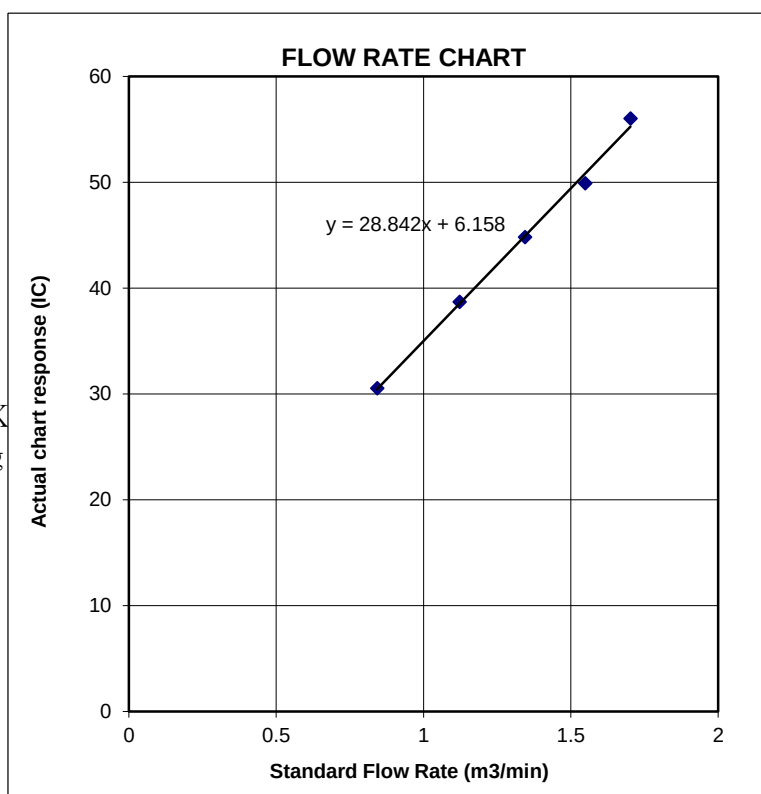

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 8, 2025 Rootsmeter S/N: 438320 Ta: 294 °K
Operator: Jim Tisch Pa: 755.7 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 1941

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4570	3.2	2.00
2	3	4	1	1.0380	6.4	4.00
3	5	6	1	0.9290	7.9	5.00
4	7	8	1	0.8850	8.8	5.50
5	9	10	1	0.7320	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
1.0035	0.6888	1.4197	0.9958	0.6834	0.8821
0.9993	0.9627	2.0078	0.9915	0.9552	1.2475
0.9973	1.0735	2.2448	0.9895	1.0652	1.3948
0.9961	1.1255	2.3543	0.9884	1.1168	1.4628
0.9907	1.3535	2.8394	0.9831	1.3430	1.7642
QSTD	m=	2.13603	QA	m=	1.33754
	b=	-0.04992		b=	-0.03102
	r=	1.00000		r=	1.00000

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsmeter manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



SUB-CONTRACTING REPORT

CONTACT	: MR BEN TAM	WORK ORDER	: HK2616155
CLIENT	: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING		
ADDRESS	: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.	SUB-BATCH	: 1
		DATE RECEIVED	: 16-APR-2026
		DATE OF ISSUE	: 23-APR-2026
PROJECT	: Not Specified	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ---

General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to Action-United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F. Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2616155
SUB-BATCH : 1
CLIENT : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING
PROJECT : Not Specified



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2616155-001	S/N : 456662 (EQ118)	AIR	16-Apr-2026	S/N : 456662 (EQ118)

----- END OF REPORT -----

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
Manufacturer: Sibata LD-3B
Serial No. 456662
Equipment Ref: EQ118

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)
Location & Location ID: Ha Pak Nai
Equipment Ref: HVS 023 (TISCH Model TE-5170 S/N:1048)
Last Calibration Date: 13 February 2026

Equipment Verification Results:

Verification Date: 20 March 2026

Date	Duration	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m ³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
20-Mar-26	60.0 mins	10:20 ~ 11:20	21.5	1015.7	46.7	1275	21.3
20-Mar-26	61.2 mins	11:23 ~ 12:24	21.5	1015.7	52.6	989	16.2
20-Mar-26	60.6 mins	12:27 ~ 13:28	21.5	1015.7	106.3	1874	30.9

Sensitivity Adjustment Scale Setting (Before Calibration) 587 (CPM)


Sensitivity Adjustment Scale Setting (After Calibration) 587 (CPM)

Linear Regression of Y or X

Slope (K-factor): 3.2251 (µg/m³)/CPM

Correlation Coefficient (R) 0.9581

Date of Issue 1 April 2026

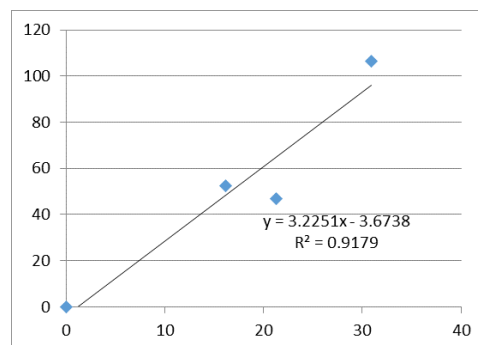

Remarks:

1. **Strong** Correlation ($R > 0.8$)
2. Factor 3.2251 (µg/m³)/CPM should be apply for TSP monitoring

*If $R < 0.5$, repair or re-verification is required for the equipment

Operator : Gary Ng Signature : [Signature] Date : 1 April 2026

QC Reviewer : Ben Tam Signature : [Signature] Date : 1 April 2026

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai
 Location ID : AM(D)3
 Model: TISCH High Volume Air Sampler TE-5170 (S/N:1048) Technician: Dicky Chan

Date of Calibration: 13-Feb-26

Next Calibration Date: 13-Apr-26

CONDITIONS

Sea Level Pressure (hPa)

1017.7

Temperature (°C)

20.2

Corrected Pressure (mm Hg)

763.275

Temperature (K)

293

CALIBRATION ORIFICE

Make-> TISCH

Model-> 5025A

Serial # -> 1941

Qstd Slope ->

2.13603

Qstd Intercept ->

-0.04992

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.30	6.30	12.6	1.702	55	56.02	Slope = 28.8418
13	5.20	5.20	10.4	1.549	49	49.91	Intercept = 6.1583
10	3.90	3.90	7.8	1.344	44	44.82	Corr. coeff. = 0.9981
7	2.70	2.70	5.4	1.123	38	38.71	
5	1.50	1.50	3.0	0.843	30	30.56	

Calculations :

$$Q_{std} = 1/m[\text{Sqrt}(H_{20}(P_a/P_{std})(T_{std}/T_a))-b]$$

$$IC = I[\text{Sqrt}(P_a/P_{std})(T_{std}/T_a)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K

Pstd = actual pressure during calibration (mm Hg

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/T_{av})(P_{av}/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

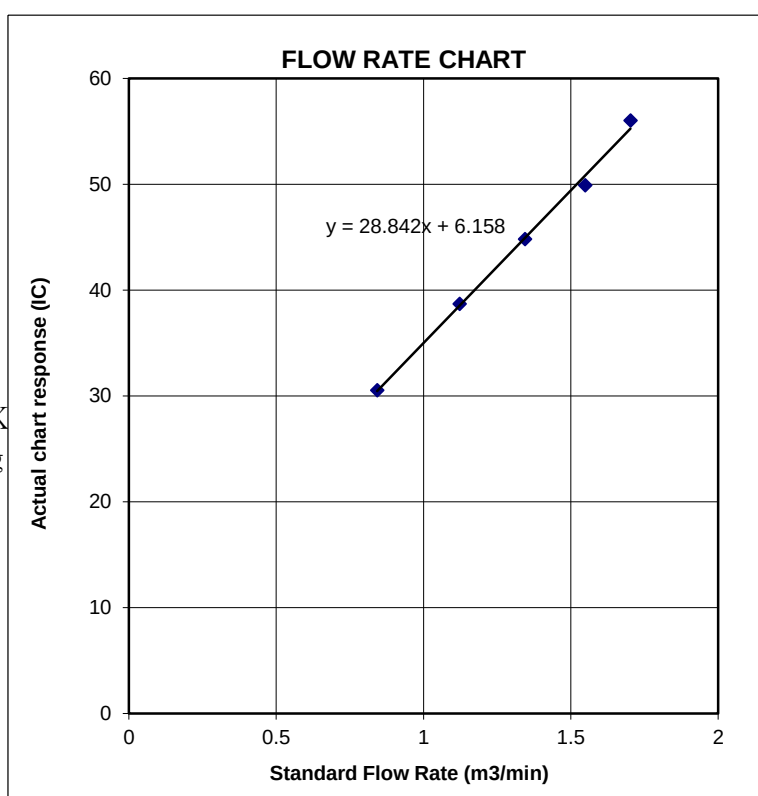

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 8, 2025 Rootsmeter S/N: 438320 Ta: 294 °K
Operator: Jim Tisch Pa: 755.7 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 1941

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4570	3.2	2.00
2	3	4	1	1.0380	6.4	4.00
3	5	6	1	0.9290	7.9	5.00
4	7	8	1	0.8850	8.8	5.50
5	9	10	1	0.7320	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
1.0035	0.6888	1.4197	0.9958	0.6834	0.8821
0.9993	0.9627	2.0078	0.9915	0.9552	1.2475
0.9973	1.0735	2.2448	0.9895	1.0652	1.3948
0.9961	1.1255	2.3543	0.9884	1.1168	1.4628
0.9907	1.3535	2.8394	0.9831	1.3430	1.7642
QSTD	m=	2.13603	QA	m=	1.33754
	b=	-0.04992		b=	-0.03102
	r=	1.00000		r=	1.00000

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	$Vstd/\Delta Time$	Qa=	$Va/\Delta Time$
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsmeter manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



SUB-CONTRACTING REPORT

CONTACT	: MR BEN TAM	WORK ORDER	: HK2614138
CLIENT	: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING		
ADDRESS	: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.	SUB-BATCH	: 1
		DATE RECEIVED	: 31-MAR-2026
		DATE OF ISSUE	: 9-APR-2026
PROJECT	: Not Specified	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ---

General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F., Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2614138
SUB-BATCH : 1
CLIENT : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING
PROJECT : Not Specified



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2614138-001	S/N: 3Y7142	AIR	31-Mar-2026	S/N: 3Y7142

----- END OF REPORT -----

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
Manufacturer: Sibata LD-5R
Serial No. 3Y7142
Equipment Ref: EQ124

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)
Location & Location ID: AUES office (calibration room)
Equipment Ref: HVS 018 (TISCH Model TE-5170X S/N:1260)
Last Calibration Date: 30 December 2025

Equipment Verification Results:

Verification Date: 16 March 2026

Date	Duration	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m ³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
16-Mar-26	120.0 mins	10:15 ~ 12:15	19.5	1018.5	48.2	1723	14.4
16-Mar-26	120.0 mins	12:25 ~ 14:25	19.5	1018.5	34.0	1477	12.3
16-Mar-26	120.0 mins	14:31 ~ 16:31	19.5	1018.5	37.3	1129	9.4

Sensitivity Adjustment Scale Setting (Before Calibration) 502 (CPM)


Sensitivity Adjustment Scale Setting (After Calibration) 501 (CPM)

Linear Regression of Y or X

Slope (K-factor): 3.1747 (µg/m³)/CPM

Correlation Coefficient (R) 0.9679

Date of Issue 25 March 2026

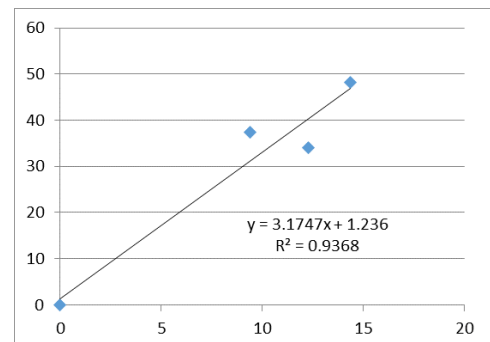

Remarks:

1. **Strong** Correlation ($R > 0.8$)
2. Factor 3.1747 (µg/m³)/CPM should be apply for TSP monitoring

*If $R < 0.5$, repair or re-verification is required for the equipment

Operator : Gary Ng Signature : [Signature] Date : 25 March 2026

QC Reviewer : Ben Tam Signature : [Signature] Date : 25 March 2026

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Gold King Industrial Building, Kwai Chung Date of Calibration: 30-Dec-25
 Location ID : Calibration Room - TISCH Higher Volume Sampler (Model TE-5170X) S/N:1260 Next Calibration Date: 30-Mar-26

CONDITIONS

Sea Level Pressure (hPa) 1015.4
 Temperature (°C) 17.1

Corrected Pressure (mm Hg) 761.55
 Temperature (K) 290

CALIBRATION ORIFICE

Make-> TISCH
 Model-> 5025A
 Calibration Date-> 8-Dec-25

Qstd Slope -> 2.13603
 Qstd Intercept -> -0.04992
 Expiry Date-> 8-Dec-26

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.7	6.7	13.4	1.762	53	53.77	Slope = 35.9268
13	5.3	5.3	10.6	1.570	45	45.66	Intercept = -10.2091
10	4.2	4.2	8.4	1.400	39	39.57	Corr. coeff. = 0.9991
8	2.7	2.7	5.4	1.127	30	30.44	
5	1.7	1.7	3.4	0.899	22	22.32	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I)[\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

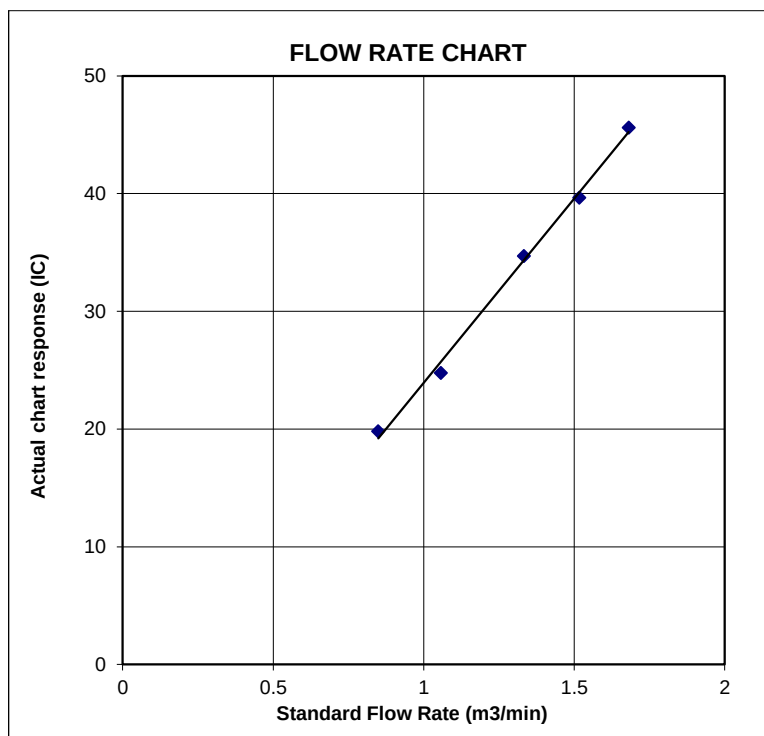

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 8, 2025 Rootsmeter S/N: 438320 Ta: 294 °K
Operator: Jim Tisch Pa: 755.7 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 1941

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4570	3.2	2.00
2	3	4	1	1.0380	6.4	4.00
3	5	6	1	0.9290	7.9	5.00
4	7	8	1	0.8850	8.8	5.50
5	9	10	1	0.7320	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
1.0035	0.6888	1.4197	0.9958	0.6834	0.8821
0.9993	0.9627	2.0078	0.9915	0.9552	1.2475
0.9973	1.0735	2.2448	0.9895	1.0652	1.3948
0.9961	1.1255	2.3543	0.9884	1.1168	1.4628
0.9907	1.3535	2.8394	0.9831	1.3430	1.7642
QSTD	m=	2.13603	QA	m=	1.33754
	b=	-0.04992		b=	-0.03102
	r=	1.00000		r=	1.00000

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsmeter manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



SUB-CONTRACTING REPORT

CONTACT	: MR BEN TAM	WORK ORDER	: HK2540548
CLIENT	: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING		
ADDRESS	: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.	SUB-BATCH	: 1
		DATE RECEIVED	: 17-SEP-2025
		DATE OF ISSUE	: 22-SEP-2025
PROJECT	: Not Specified	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ---

General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.
- No sample is received in this Work Order. The report presents non-laboratory testing data only.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F., Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2540548
SUB-BATCH : 1
CLIENT : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING
PROJECT : Not Specified



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2540548-001	S/N: 467389	AIR	17-Sep-2025	S/N: 467389

----- END OF REPORT -----

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
Manufacturer: Sibata LD-5R
Serial No. 467389
Equipment Ref: EQ125

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)
Location & Location ID: Ha Pak Nai
Equipment Ref: HVS 023
Last Calibration Date: 16 August 2025

Equipment Verification Results:

Verification Date: 3 September 2025

Date	Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m ³ (Standard Equipment)	Total Count (Calibrated Equipment)	Count/Minute (Total Count/min)
3-Sep-25	1hr00min	11:18 ~ 12:18	30.5	1008.2	90.9	4773	79.6
3-Sep-25	1hr00min	12:23 ~ 13:23	30.5	1008.2	49.7	2326	38.8
3-Sep-25	1hr00min	13:28 ~ 14:28	30.5	1008.2	128.5	5868	97.8

Sensitivity Adjustment Scale Setting (Before Calibration) 704 (CPM)

Sensitivity Adjustment Scale Setting (After Calibration) 705 (CPM)

Linear Regression of Y or X

Slope (K-factor): 1.2561 (µg/m³)/CPM


Correlation Coefficient (R) 0.9938

Date of Issue 10 September 2025

Remarks:

- Strong** Correlation ($R > 0.8$)
- Factor 1.2561 (µg/m³)/CPM should be apply for TSP monitoring

*If $R < 0.5$, repair or re-verification is required for the equipment

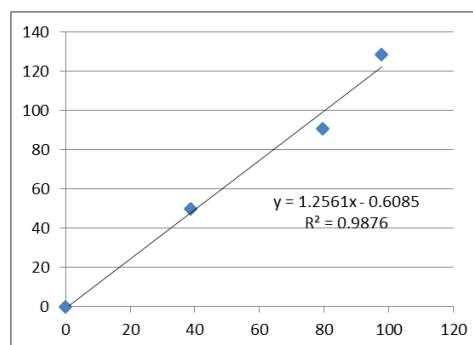

Operator : Gary Ng Signature : [Signature] Date : 10 September 2025

QC Reviewer : Ben Tam Signature : [Signature] Date : 10 September 2025

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Ha Pak Nai Date of Calibration: 16-Aug-25
 Location ID : AM(D)3 Next Calibration Date: 16-Oct-25
 Model: TISCH High Volume Air Sampler TE-5170

CONDITIONS

Sea Level Pressure (hPa)	1008.5	Corrected Pressure (mm Hg)	756.375
Temperature (°C)	29.3	Temperature (K)	302

CALIBRATION ORIFICE

Make->	TISCH	Qstd Slope ->	2.09671
Model->	5025A	Qstd Intercept ->	-0.01852
Calibration Date->	16-Dec-24	Expiry Date->	16-Dec-25

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.4	6.4	12.8	1.699	54	53.10	Slope = 26.8673 Intercept = 7.0086 Corr. coeff. = 0.9983
13	5.2	5.2	10.4	1.532	49	48.19	
10	3.8	3.8	7.6	1.311	42	41.30	
8	2.6	2.6	5.2	1.086	37	36.39	
5	1.5	1.5	3.0	0.827	30	29.50	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$


$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate
 IC = corrected chart responses
 I = actual chart response
 m = calibrator Qstd slope
 b = calibrator Qstd intercept
 Ta = actual temperature during calibration (deg K)
 Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I) [\text{Sqrt}(298/Tav)(Pav/760)]-b)$$

m = sampler slope
 b = sampler intercept
 I = chart response
 Tav = daily average temperature
 Pav = daily average pressure

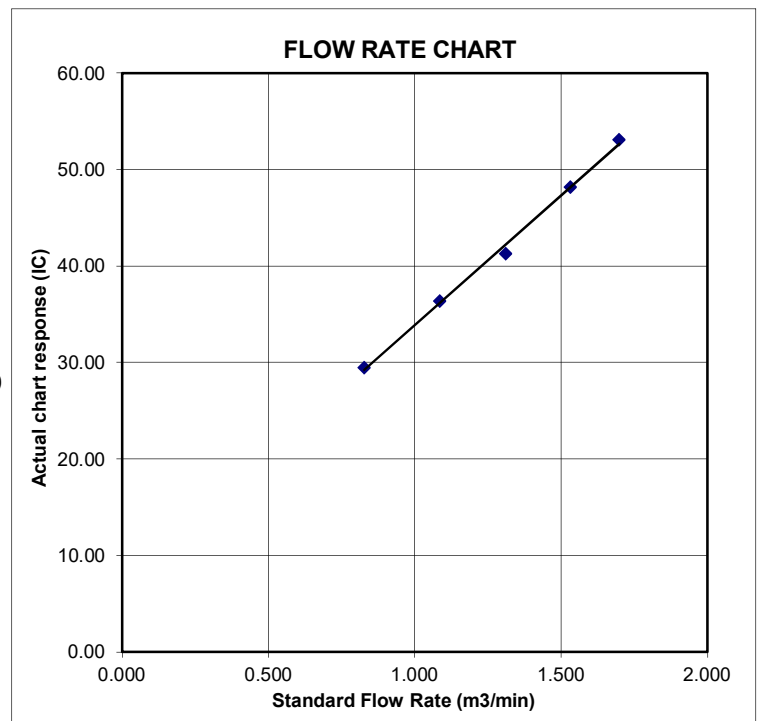



Certificate of Calibration

Calibration Certification Information

Cal. Date: December 16, 2024 Rootsometer S/N: 438320 Ta: 293 °K
Operator: Jim Tisch Pa: 749.0 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 4064

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4600	3.2	2.00
2	3	4	1	1.0300	6.4	4.00
3	5	6	1	0.9220	8.0	5.00
4	7	8	1	0.8770	8.8	5.50
5	9	10	1	0.7250	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
0.9981	0.6836	1.4159	0.9957	0.6820	0.8845
0.9938	0.9649	2.0024	0.9915	0.9626	1.2509
0.9917	1.0756	2.2388	0.9893	1.0730	1.3985
0.9906	1.1296	2.3480	0.9883	1.1269	1.4668
0.9853	1.3590	2.8318	0.9829	1.3557	1.7690
QSTD	m=	2.09671	QA	m=	1.31292
	b=	-0.01852		b=	-0.01157
	r=	0.99999		r=	0.99999

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	$Vstd/\Delta Time$	Qa=	$Va/\Delta Time$
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsometer manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30



SUB-CONTRACTING REPORT

CONTACT	: MR BEN TAM	WORK ORDER	: HK2603525
CLIENT	: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING		
ADDRESS	: RM A 20/F., GOLD KING IND BLDG, NO. 35-41 TAI LIN PAI ROAD, KWAI CHUNG, N.T.	SUB-BATCH	: 1
		DATE RECEIVED	: 22-JAN-2026
		DATE OF ISSUE	: 27-JAN-2026
PROJECT	: Not Specified	NO. OF SAMPLES	: 1
		CLIENT ORDER	: ---

General Comments

- Sample information (Project name, Sample ID, Sampling date/time, etc.) is provided by client.
- Result(s) of sample(s) is/are reported on as received basis, unless otherwise specified. The result(s) is/are related only to the item(s) tested.
- Sample(s) was/ were submitted by client. Sample(s) arrived laboratory in ambient condition.
- Calibration was subcontracted to and analysed by Action United Environmental Services & Consulting.

Signatories

This document has been signed by those names that appear on this report and are the authorised signatories

Signatories

Position

Richard Fung

Managing Director

This report supersedes any previous report(s) with the same work order number.

All pages of this report have been checked and approved for release.

ALS Technichem (HK) Pty Ltd
Part of the **ALS Laboratory Group**

11/F. Chung Shun Knitting Centre 1 - 3 Wing Yip Street Kwai Chung N.T. Hong Kong
Tel. +852 2610 1044 Fax. +852 2610 2021 www.alsglobal.com

WORK ORDER : HK2603525
SUB-BATCH : 1
CLIENT : ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING
PROJECT : Not Specified



ALS Lab ID	Client's Sample ID	Sample Type	Sample Date	External Lab Report No.
HK2603525-001	S/N: 5Y8215	AIR	22-Jan-2026	S/N: 5Y8215

----- END OF REPORT -----

Equipment Verification Report (TSP)

Equipment Calibrated:

Type: Laser Dust monitor
Manufacturer: Sibata LD-5R
Serial No. 5Y8215
Equipment Ref: EQ129
Job Order NA

Standard Equipment:

Standard Equipment: Higher Volume Sampler (TSP)
Location & Location ID: AUES office (calibration room)
Equipment Ref: HVS 018 (TISCH Model TE-5170X S/N:1260)
Last Calibration Date: 30 December 2025


Equipment Verification Results:

Verification Date: 2 January 2026

Hour	Time	Mean Temp °C	Mean Pressure (hPa)	Concentration in ug/m ³ (Standard Equipment)	Concentration in ug/m ³ (Calibrated Equipment)	Tolerance (ug/m ³)
2hr02min	10:15 ~ 12:17	15.0	1023.5	32.7	10.7	-22.0
2hr00min	12:20 ~ 14:20	15.0	1023.5	24.4	8.6	-15.8
2hr01min	14:27 ~ 16:28	15.0	1023.5	30.6	9.8	-20.7

Linear Regression of Y or X

Slope (K-factor): 3.0457 (µg/m³)/CPM
Correlation Coefficient (R) 0.9977
Date of Issue 13 January 2026

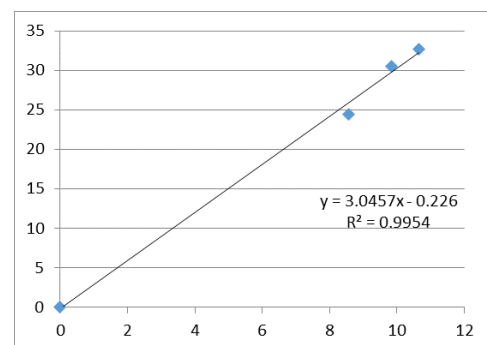

Remarks:

- Strong** Correlation ($R > 0.8$)
- Factor 3.0457 (µg/m³)/CPM should be applied for TSP monitoring

*If $R < 0.5$, repair or re-verification is required for the equipment

Operator : Jeff Ip Signature : [Signature] Date : 13 January 2026

QC Reviewer : Ben Tam Signature : [Signature] Date : 13 January 2026

TSP SAMPLER CALIBRATION CALCULATION SPREADSHEET

Location : Gold King Industrial Building, Kwai Chung Date of Calibration: 30-Dec-25
 Location ID : Calibration Room - TISCH Higher Volume Sampler (Model TE-5170X) S/N:1260 Next Calibration Date: 30-Mar-26

CONDITIONS

Sea Level Pressure (hPa) 1015.4
 Temperature (°C) 17.1

Corrected Pressure (mm Hg) 761.55
 Temperature (K) 290

CALIBRATION ORIFICE

Make-> TISCH
 Model-> 5025A
 Calibration Date-> 8-Dec-25

Qstd Slope -> 2.13603
 Qstd Intercept -> -0.04992
 Expiry Date-> 8-Dec-26

CALIBRATION

Plate No.	H2O (L) (in)	H2O (R) (in)	H2O (in)	Qstd (m3/min)	I (chart)	IC corrected	LINEAR REGRESSION
18	6.7	6.7	13.4	1.762	53	53.77	Slope = 35.9268
13	5.3	5.3	10.6	1.570	45	45.66	Intercept = -10.2091
10	4.2	4.2	8.4	1.400	39	39.57	Corr. coeff. = 0.9991
8	2.7	2.7	5.4	1.127	30	30.44	
5	1.7	1.7	3.4	0.899	22	22.32	

Calculations :

$$Qstd = 1/m[\text{Sqrt}(H2O(Pa/Pstd)(Tstd/Ta))-b]$$

$$IC = I[\text{Sqrt}(Pa/Pstd)(Tstd/Ta)]$$

Qstd = standard flow rate

IC = corrected chart responses

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pstd = actual pressure during calibration (mm Hg)

For subsequent calculation of sampler flow:

$$1/m((I)[\text{Sqrt}(298/Tav)(Pav/760)]-b)$$


m = sampler slope

b = sampler intercept

I = chart response

Tav = daily average temperature

Pav = daily average pressure

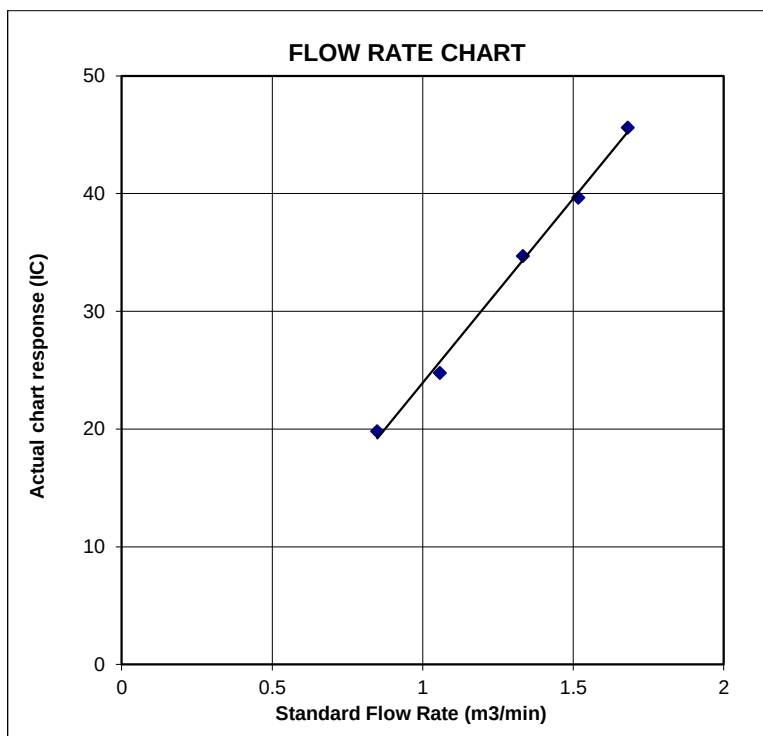

Certificate of Calibration

Calibration Certification Information

Cal. Date: December 8, 2025 Rootsmeter S/N: 438320 Ta: 294 °K
Operator: Jim Tisch Pa: 755.7 mm Hg
Calibration Model #: TE-5025A Calibrator S/N: 1941

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4570	3.2	2.00
2	3	4	1	1.0380	6.4	4.00
3	5	6	1	0.9290	7.9	5.00
4	7	8	1	0.8850	8.8	5.50
5	9	10	1	0.7320	12.8	8.00

Data Tabulation

Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)}$ (y-axis)	Va	Qa (x-axis)	$\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)}$ (y-axis)
1.0035	0.6888	1.4197	0.9958	0.6834	0.8821
0.9993	0.9627	2.0078	0.9915	0.9552	1.2475
0.9973	1.0735	2.2448	0.9895	1.0652	1.3948
0.9961	1.1255	2.3543	0.9884	1.1168	1.4628
0.9907	1.3535	2.8394	0.9831	1.3430	1.7642
QSTD	m=	2.13603	QA	m=	1.33754
	b=	-0.04992		b=	-0.03102
	r=	1.00000		r=	1.00000

Calculations

Vstd=	$\Delta Vol((Pa-\Delta P)/Pstd)(Tstd/Ta)$	Va=	$\Delta Vol((Pa-\Delta P)/Pa)$
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
For subsequent flow rate calculations:			
Qstd=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) - b \right)$	Qa=	$1/m \left(\left(\sqrt{\Delta H \left(\frac{Ta}{Pa} \right)} \right) - b \right)$

Standard Conditions

Tstd: 298.15 °K
Pstd: 760 mm Hg

Key

ΔH: calibrator manometer reading (in H2O)
ΔP: rootsmeter manometer reading (mm Hg)
Ta: actual absolute temperature (°K)
Pa: actual barometric pressure (mm Hg)
b: intercept
m: slope

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Appendix E2

Calibration Certificates for

Noise Monitoring Equipment

Certificate of Calibration

for

Description: *Sound Level Meter*
Manufacturer: *RION*
Type No.: *NL-52A (Serial No.: 00620666)*
Microphone: *UC-59 (Serial No.: 27004)*
Preamplifier: *NH-25 (Serial No.: 21916)*

Submitted by:

Customer: *Action-United Environmental Services & Consulting*
Address: *Unit A, 20/F, Gold King Industrial Building*
35-41 Tai Lin Pai Road, Kwai Chung,
New Territories, Hong Kong

Upon receipt for calibration, the instrument was found to be:

☒ **Within (31.5Hz – 4kHz)**
☐ **Outside**
the allowable tolerance.


The test equipment used for calibration are traceable to National Standards via:


- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 03 July 2025

Date of calibration: 04 July 2025

Date of NEXT calibration: 03 July 2026

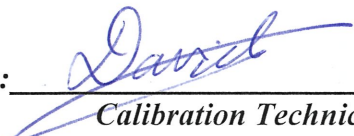Calibrated by: 
Calibration Technician

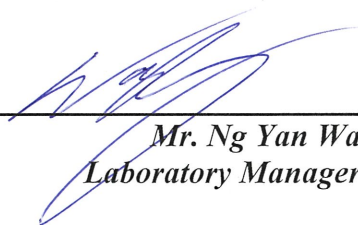Certified by: 
Mr. Ng Yan Wa
Laboratory Manager

Date of issue: 04 July 2025

Certificate No.: APJ25-008-CC006



Page 1 of 4

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: 24.7 °C

Air Pressure: 1006 hPa

Relative Humidity: 52.6 %

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV240081	HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA SPL	Fast	94	1000	94.0	±0.4


Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA SPL	Fast	94	1000	94.0	Ref
			104		104.0	±0.3
			114		114.0	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA SPL	Fast	94	1000	94.0	Ref
		Slow			94.0	±0.3

Certificate No.: APJ25-008-CC006

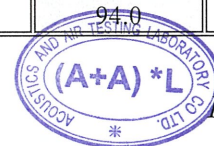

Page 2 of 4

Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz		
30-130	dB	SPL	94	31.5	93.9	±2.0
				63	94.1	±1.5
				125	94.1	±1.5
				250	94.0	±1.4
				500	94.0	±1.4
				1000	94.0	Ref
				2000	93.6	±1.6
				4000	92.8	±1.6

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz		
30-130	dBA	SPL	94	31.5	54.4	-39.4 ±2.0
				63	67.9	-26.2 ±1.5
				125	78.0	-16.1 ±1.5
				250	85.4	-8.6 ±1.4
				500	90.8	-3.2 ±1.4
				1000	94.0	Ref
				2000	94.9	+1.2 ±1.6
				4000	93.9	+1.0 ±1.6

C-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading, dB	IEC 61672 Class 1 Specification, dB
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz		
30-130	dBC	SPL	94	31.5	90.9	-3.0 ±2.0
				63	93.3	-0.8 ±1.5
				125	93.9	-0.2 ±1.5
				250	94.0	-0.0 ±1.4
				500	94.0	-0.0 ±1.4
				1000	94.0	Ref
				2000	93.5	-0.2 ±1.6
				4000	92.1	-0.8 ±1.6

Certificate No.: APJ25-008-CC006



Page 3 of 4

5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.10
	125 Hz	± 0.05
	250 Hz	± 0.10
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.



Certificate No.: APJ25-008-CC006

Page 4 of 4



新創校正服務有限公司
New Creation Calibration Service Limited

Certificate of Calibration

校正證書

Certificate No. : C252625
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC25-0908) Date of Receipt / 收件日期 : 7 November 2025

Description / 儀器名稱 : Integrating Sound Level Meter (EQ009)
Manufacturer / 製造商 : Brüel & Kjær
Model No. / 型號 : 2238
Serial No. / 編號 : 2285722
Supplied By / 委託者 : Action-United Environmental Services and Consulting
Unit A, 20/F., Gold King Industrial Building,
35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 : $(23 \pm 3)^{\circ}\text{C}$ Relative Humidity / 相對濕度 : $(50 \pm 25)\%$
Line Voltage / 電壓 : ---

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 18 November 2025


TEST RESULTS / 測試結果

The results apply to the particular unit-under-test only.
The results do not exceed specified limits.
These limits refer to manufacturer's published tolerances as requested by the customer.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- Hottinger Brüel & Kjær Calibration Laboratory, Denmark
- Thurlby Thandar Instruments Ltd., UK

Tested By : 
測試 C K Lo
Project Engineer

Certified By : 
核證 K C Lee
Senior Engineer

Date of Issue : 19 November 2025
簽發日期

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

New Creation Calibration Service Limited
Flat F & G, 11/F, Garment Centre, 576-586 Castle Peak Road, Cheung Sha Wan, Kowloon, Hong Kong

新創校正服務有限公司

香港九龍長沙灣青山道576-586號製衣中心11樓F及G室

Tel/電話: (852) 2736 3335

Fax/傳真: (852) 2736 3332

E-mail/電郵: callab@nccsvc.com.hk

Website/網址: www.nccsvc.com.hk



Certificate of Calibration

校正證書

Certificate No. : C252625
證書編號

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 1 hour, and switched on to warm up for over 10 minutes before the commencement of the test.
- Self-calibration using laboratory acoustic calibrator was performed before the test from 6.1.1.2 to 6.4.
- The results presented are the mean of 3 measurements at each calibration point.
- Test equipment :

Equipment ID	Description	Certificate No.
CL458	Dual Function / Arb / Pulse Generator	3001978
CL461	Sound Calibrator	CDK2502138

- Test procedure : MA101N.

- Results :

6.1 Sound Pressure Level

6.1.1 Reference Sound Pressure Level

6.1.1.1 Before Self-calibration

UUT Setting				Applied Value		UUT Reading
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	(dB)
52 - 132	L _{AFP}	A	F	94.00	1	92.4

6.1.1.2 After Self-calibration

UUT Setting				Applied Value		UUT Reading	IEC 60651 Type 1 Limit
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	(dB)	(dB)
54 - 134	L _{AFP}	A	F	94.00	1	94.0	± 0.7

6.1.2 Linearity

UUT Setting				Applied Value		UUT Reading
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)	(dB)
54 - 134	L _{AFP}	A	F	94.00	1	94.0 (Ref.)
				104.00		104.0
				114.00		113.9

IEC 60651 Type 1 Limit : ± 0.4 dB per 10 dB step and ± 0.7 dB for overall different.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。

New Creation Calibration Service Limited

Flat F & G, 11/F, Garment Centre, 576-586 Castle Peak Road, Cheung Sha Wan, Kowloon, Hong Kong

新創校正服務有限公司

香港九龍長沙灣青山道576-586號製衣中心11樓F及G室

Tel/電話: (852) 2736 3335

Fax/傳真: (852) 2736 3332

E-mail/電郵: callab@nccsvc.com.hk

Website/網址: www.nccsvc.com.hk



Certificate of Calibration

校正證書

Certificate No. : C252625
證書編號

6.2 Time Weighting

6.2.1 Continuous Signal

UUT Setting				Applied Value		UUT Reading (dB)	IEC 60651 Type 1 Limit (dB)
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq. (kHz)		
54 - 134	L _{AFP}	A	F	94.00	1	94.0	Ref.
	L _{ASP}		S			94.0	± 0.1
	L _{AIP}		I			94.1	± 0.1

6.2.2 Tone Burst Signal (2 kHz)

UUT Setting				Applied Value		UUT Reading (dB)	IEC 60651 Type 1 Limit (dB)
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Burst Duration		
34 - 114	L _{AFP}	A	F	106.0	Continuous	106.0	Ref.
	L _{AFMax}				200 ms	105.0	-1.0 ± 1.0
	L _{ASP}	S	Continuous		106.0	Ref.	
	L _{ASMax}		500 ms		102.0	-4.1 ± 1.0	

6.3 Frequency Weighting

6.3.1 A-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 60651 Type 1 Limit (dB)
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
54 - 134	L _{AFP}	A	F	94.00	31.5 Hz	54.7	-39.4 ± 1.5
					63 Hz	68.0	-26.2 ± 1.5
					125 Hz	77.8	-16.1 ± 1.0
					250 Hz	85.3	-8.6 ± 1.0
					500 Hz	90.8	-3.2 ± 1.0
					1 kHz	94.0	Ref.
					2 kHz	95.2	+1.2 ± 1.0
					4 kHz	94.9	+1.0 ± 1.0
					8 kHz	92.8	-1.1 (+1.5 ; -3.0)
					12.5 kHz	89.7	-4.3 (+3.0 ; -6.0)

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗所書面批准。



Certificate of Calibration

校正證書

Certificate No. : C252625

證書編號

6.3.2 C-Weighting

UUT Setting				Applied Value		UUT Reading (dB)	IEC 60651 Type 1 Limit (dB)
Range (dB)	Parameter	Frequency Weighting	Time Weighting	Level (dB)	Freq.		
54 - 134	L _{CFP}	C	F	94.00	31.5 Hz	90.9	-3.0 ± 1.5
					63 Hz	93.2	-0.8 ± 1.5
					125 Hz	93.8	-0.2 ± 1.0
					250 Hz	94.0	0.0 ± 1.0
					500 Hz	94.0	0.0 ± 1.0
					1 kHz	94.0	Ref.
					2 kHz	93.8	-0.2 ± 1.0
					4 kHz	93.1	-0.8 ± 1.0
					8 kHz	90.9	-3.0 (+1.5 ; -3.0)
					12.5 kHz	87.8	-6.2 (+3.0 ; -6.0)

6.4 Time Averaging

UUT Setting				Applied Value					UUT Reading (dB)	IEC 60804 Type 1 Limit (dB)
Range (dB)	Parameter	Frequency Weighting	Integrating Time	Freq. (kHz)	Burst Duration (ms)	Burst Duty Factor	Burst Level (dB)	Equivalent Level (dB)		
34 - 114	L _{Aeq}	A	10 sec.	4	1	1/10	110.0	100	99.8	± 0.5
						1/10 ²		90	90.0	± 0.5
			60 sec.			1/10 ³		80	79.6	± 1.0
			5 min.			1/10 ⁴		70	69.6	± 1.0

Remarks : - UUT Microphone Model No. : 4188 & S/N : 2812706

- Mfr's Limit : IEC 60651 Type 1 & IEC 60804 Type 1

- Uncertainties of Applied Value : 94 dB : 31.5 Hz - 125 Hz : ± 0.35 dB
250 Hz - 500 Hz : ± 0.30 dB
1 kHz : ± 0.20 dB
2 kHz - 4 kHz : ± 0.35 dB
8 kHz : ± 0.45 dB
12.5 kHz : ± 0.70 dB
104 dB : 1 kHz : ± 0.10 dB (Ref. 94 dB)
114 dB : 1 kHz : ± 0.10 dB (Ref. 94 dB)
Burst equivalent level : ± 0.2 dB (Ref. 110 dB continuous sound level)

- The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. New Creation Calibration Service Limited shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。

New Creation Calibration Service Limited
Flat F & G, 11/F, Garment Centre, 576-586 Castle Peak Road, Cheung Sha Wan, Kowloon, Hong Kong

新創校正服務有限公司

香港九龍長沙灣青山道576-586號製衣中心11樓F及G室

Tel/電話: (852) 2736 3335 Fax/傳真: (852) 2736 3332

E-mail/電郵: callab@nccsvc.com.hk

Website/網址: www.nccsvc.com.hk



新創校正服務有限公司
New Creation Calibration Service Limited

Certificate of Calibration

校正證書

Certificate No. : C260173
證書編號

ITEM TESTED / 送檢項目 (Job No. / 序引編號 : IC26-0008)

Date of Receipt / 收件日期 : 5 January 2026

Description / 儀器名稱 : Sound Calibrator (EQ083)
Manufacturer / 製造商 : Rion
Model No. / 型號 : NC-74
Serial No. / 編號 : 34246492
Supplied By / 委託者 : Action-United Environmental Services and Consulting
Unit A, 20/F., Gold King Industrial Building,
35-41 Tai Lin Pai Road, Kwai Chung, N.T.

TEST CONDITIONS / 測試條件

Temperature / 溫度 : $(23 \pm 3)^{\circ}\text{C}$
Line Voltage / 電壓 : ---

Relative Humidity / 相對濕度 : $(50 \pm 25)\%$

TEST SPECIFICATIONS / 測試規範

Calibration check

DATE OF TEST / 測試日期 : 20 January 2026

TEST RESULTS / 測試結果


The results apply to the particular unit-under-test only.
The results do not exceed specified limits.
These limits refer to manufacturer's published tolerances as requested by the customer.
The results are detailed in the subsequent page(s).

The test equipment used for calibration are traceable to National Standards via :

- Hottinger Brüel & Kjær Calibration Laboratory, Denmark
- Agilent Technologies / Keysight Technologies


Tested By
測試

:


C K Lo
Project Engineer

Certified By
核證

:

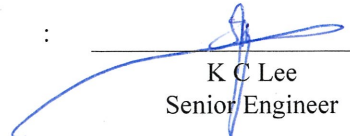
K C Lee
Senior Engineer

Date of Issue
簽發日期

:

21 January 2026

The test equipment used for calibration is traceable to the National Standards as specified in this certificate. This certificate shall not be reproduced except in full, without the prior written approval of this laboratory.

本證書所載校正用之測試器材均可溯源至國際標準。局部複印本證書需先獲本實驗室書面批准。



Certificate of Calibration

校正證書

Certificate No. : C260173
證書編號

1. The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 1 hour before the commencement of the test.
2. The results presented are the mean of 3 measurements at each calibration point.
3. Test equipment :

Equipment ID	Description	Certificate No.
CL456	6 1/2 Digit Multimeter	SO219304-4
CL461	Sound Calibrator	CDK2502138

4. Test procedure : MA100N.

5. Results :

5.1 Sound Level Accuracy

UUT Nominal Value	Measured Value	Mfr's Limit	Uncertainty of Measured Value
94 dB, 1 kHz	94.2 dB	± 0.3 dB	± 0.2 dB

5.2 Frequency Accuracy

UUT Nominal Value	Measured Value	Mfr's Limit	Uncertainty of Measured Value
1 kHz	1.002 kHz	1 kHz ± 1 %	± 1 Hz

Remark : The uncertainties are for a confidence probability of not less than 95 %.

Note :

Only the original copy or the laboratory's certified true copy is valid.

The values given in this Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environment changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. New Creation Calibration Service Limited shall not be liable for any loss or damage resulting from the use of the equipment.

Appendix E3

Calibration Certificates for

Water Quality Monitoring Equipment



ALS Technichem (HK) Pty Ltd

11/F., Chung Shun Knitting Centre,
1 - 3 Wing Yip Street,
Kwai Chung, N.T., Hong Kong

T: +852 2610 1044

F: +852 2610 2021

www.alsglobal.com

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: BEN TAM
CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES &
ADDRESS: RM A 20/F., GOLD KING IND BLDG,
NO. 35-41 TAI LIN PAI ROAD,
KWAI CHUNG, N.T.

WORK ORDER: HK2617279
SUB-BATCH: 0
LABORATORY: HONG KONG
DATE RECEIVED: 24-Apr-2026
DATE OF ISSUE: 04-May-2026

GENERAL COMMENTS

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

This report superseded any previous report(s) with same work order number.

EQUIPMENT INFORMATION

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client.

Equipment Type: Multifunctional Meter

Service Nature: Performance Check

Scope: Conductivity, Dissolved Oxygen, pH Value, Turbidity, Salinity and Temperature

Brand Name/ Model No.: [YSI]/ [Professional DSS]

Serial No./ Equipment No.: [20J101862/ 15H103928]/ [EQW018]

Date of Calibration: 29-April-2026

Ms. Lin Wai Yu, Iris
Assistant Manager - Inorganics

This report shall not be reproduced except in full without the written approval of the laboratory.

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2617279
SUB-BATCH: 0
DATE OF ISSUE: 04-May-2026
CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [Professional DSS]
Serial No./ Equipment No.: [20J101862/ 15H103928]/ [EQW018]
Date of Calibration: 29-April-2026 Date of Next Calibration: 29-July-2026

PARAMETERS:

Conductivity

Method Ref: APHA (23rd edition), 2510B

Expected Reading ($\mu\text{S}/\text{cm}$)	Displayed Reading ($\mu\text{S}/\text{cm}$)	Tolerance (%)
146.9	157.1	+6.9
6667	6543	-1.9
12890	12246	-5.0
58670	57491	-2.0
	Tolerance Limit (%)	± 10.0

Dissolved Oxygen

Method Ref: APHA (23rd edition), 4500O: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
2.82	2.90	+0.08
5.58	5.53	-0.05
7.21	7.19	-0.02
	Tolerance Limit (mg/L)	± 0.20

pH Value

Method Ref: APHA (23rd edition), 4500H: B

Expected Reading (pH unit)	Displayed Reading (pH unit)	Tolerance (pH unit)
4.0	3.91	-0.09
7.0	7.02	+0.02
10.0	10.02	+0.02
	Tolerance Limit (pH unit)	± 0.20

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Ms. Lin Wai Yu, Iris
Assistant Manager - Inorganics

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2617279
SUB-BATCH: 0
DATE OF ISSUE: 04-May-2026
CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [Professional DSS]
Serial No./ Equipment No.: [20J101862/ 15H103928]/ [EQW018]
Date of Calibration: 29-April-2026 Date of Next Calibration: 29-July-2026

PARAMETERS:

Turbidity

Method Ref: APHA (23rd edition), 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.49	--
4	4.36	+9.0
40	40.94	+2.3
80	79.12	-1.1
400	378.71	-5.3
800	750.41	-6.2
Tolerance Limit (%)		±10.0

Salinity

Method Ref: APHA (23rd edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.00	--
10	10.56	+5.6
20	21.14	+5.7
30	31.56	+5.2
Tolerance Limit (%)		±10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Ms. Lin Wai Yu, Iris
Assistant Manager - Inorganics

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2617279
SUB-BATCH: 0
DATE OF ISSUE: 04-May-2026
CLIENT: ACTION-UNITED ENVIRONMENTAL SERVICES & CONSULTING

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [Professional DSS]
Serial No./ Equipment No.: [20J101862/ 15H103928]/ [EQW018]
Date of Calibration: 29-April-2026 Date of Next Calibration: 29-July-2026

PARAMETERS:

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
10.0	10.3	+0.3
23.0	22.5	-0.5
40.0	39.3	-0.7
	Tolerance Limit (°C)	±2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Ms. Lin Wai Yu, Iris
Assistant Manager - Inorganics



ALS Technichem (HK) Pty Ltd

11/F., Chung Shun Knitting Centre,
1 - 3 Wing Yip Street,
Kwai Chung, N.T., Hong Kong

T: +852 2610 1044

F: +852 2610 2021

www.alsglobal.com

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT: MR BEN TAM
CLIENT: ACTION UNITED ENVIRONMENT SERVICES AND
CONSULTING
ADDRESS: UNIT A ,20/F., GOLD KING INDUSTRIAL BUILDING,
NO. 35-41 TAI LIN PAI ROAD,
KWAI CHUNG, N.T. HONG KONG

WORK ORDER: HK2607614

SUB-BATCH: 0

LABORATORY: HONG KONG

DATE RECEIVED: 13-Feb-2026

DATE OF ISSUE: 24-Feb-2026

GENERAL COMMENTS

The calibration of flow rate performed by AUES staff on 09 February 2026.

The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

This report superseded any previous report(s) with same work order number.

EQUIPMENT INFORMATION

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client.

Equipment Type: Current Meter
Service Nature: Performance Check
Scope: Current
Brand Name/ Model No.: [Valeport] / [Model 106]
Serial No./ Equipment No.: [60011] / [N/A]
Date of Calibration: 09 February, 2026


Mr. Fung Lim Chee, Richard
Managing Director, Life Sciences
Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



Work Order: HK2607614
Sub-batch: 0
Date of Issue: 24-Feb-2026
Client: ACTION UNITED ENVIRONMENT SERVICES AND CONSULTING

Reference Equipment:

Flow Rate Model: SonTek IQ Standard
Serial Number : IQ1217004
Direction Model: Magnetic Compass

Equipment to be calibrated:

Equipment Type: Current Meter
Brand Name/ [Valeport] / [Model 106]
Model No:
Serial No./ [60011] / [N/A]
Equipment No.:
Date of Calibration: 09 February, 2026


Parameters: The calibration of current meter is verified with standard flow meter and magnetic compass on site by AUES Staff.

Flow rate

Trial	Reading of Reference Equipment (m/s) SonTek IQ Standard Serial No: IQ1217004	Reading of Equipment to be calibrated (m/s) Valeport Model 106 Serial No. 60011
1	0.16	0.15
2	0.32	0.34
3	0.44	0.45
4	0.65	0.65
5	0.86	0.87
6	1.13	1.11

Direction

Trial	Reading of Reference Equipment (Degree) Magnetic Compass	Reading of Equipment to be calibrated (Degree) Valeport Model 106 Serial No. 60011
1	045	044
2	090	089
3	135	137
4	180	180
5	270	271
6	355	354

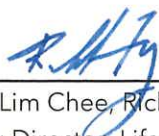
Mr. Fung Lim Chee, Richard
Managing Director, Life Sciences
Hong Kong



Hong Kong Accreditation Service
香港認可處

Certificate of Accreditation
認可證書

This is to certify that
特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong
香港新界葵涌永業街1-3號忠信針織中心11樓

*is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017
for performing specific laboratory activities as listed in the scope of accreditation within the test category of*
獲香港認可處根據ISO/IEC 17025:2017認可
進行載於認可範圍內下述測試類別中的指定實驗所活動

Environmental Testing
環境測試

*This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and
the implementation of a management system relevant to laboratory operation
(see joint IAF-ILAC-ISO Communiqué).*
此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並
實施一套與實驗所運作相關的管理體系
(見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive
現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator
執行幹事 沈偉良
Issue Date : 28 February 2020
簽發日期：二零二零年二月二十八日

Registration Number : **HOKLAS 066**
註冊號碼：



Date of First Registration : 15 September 1995
首次註冊日期：一九九五年九月十五日

Appendix E4

Calibration Certificates for

LFG Monitoring Equipment



YSF

Corporation Ltd.

5A, Blk1 Kin Ho Ind. Bldg., 20-24 Au Pui Wan St., Fo Tan, Shatin, N.T., HK.
Tel: (852) 8109 8368 Fax: (852) 3007 4857 E-mail: sales@ysftool.com
www.sokkia.com.hk www.ysf.com.hk
Supply, Repair, Rental, Scanning and Calibration Service of Surveying Instruments and Accessories

Certificate No. : CAL250575

Page 1 of 1

CALIBRATION CERTIFICATE OF GAS ANALYSER

Client : China State Construction Engineering (Hong Kong) Ltd.
Address : 29/F., China Overseas Bldg., 139 Hennessy Road, Hong Kong

Unit-Under-Test (UUT) Information

Description : Gas Analyser
Manufacturer : Geotech
Model No. : GEM5000
Serial No. : G510348

Calibrator Information

Description : (1) 4 in 1 Standard gases (O₂, CH₄, H₂S, CO) (2) Std CO₂ gas (0.3%)
Serial No. : (1) C-048-09 (2) C-087-04
Cylinder No. : (1) 51104041 (2) M123850
Expired date : (1) 12/2026 (2) 12/2026

Received date : 4 Dec., 2025
Date of calibration : 10 Dec., 2025
Next calibration date : 9 Dec., 2026
Calibration location : YSF Calibration Laboratory
Environmental conditions : 19.8 - 21.2°C / 49 - 60%RH
Method used : By direct comparison

Calibration Results :

Parameters	Measured value
(1) Methane (2.50%)	2.46%
(2) Oxygen (18.0%)	18.1%
(3) Carbon dioxide (0.3%)	0.3%

Remark :

1. The equipment used in this calibration is traceable to recognized National Standards.

Tested by : Lam Man Kwong Date : 10 Dec., 2025 Certified by : So Chi Kuen Date : 10 Dec., 2025
So Chi Kuen (Lab Manager)

**** End of Certificate ****



TEST CERTIFICATE

Model NO: SKY3000-R5		Serial NO : 02100C61C8003		
			Date of issue: 2026.01.30	
version NO: V4.5			Next Calibration : 2027.01.29	
Appearance/structure/function/mark inspection				
Item	Test results			Remark
Appearance/Structure	☒ Passed	☐ Failed	☐ Other	
Function	☒ Passed	☐ Failed	☐ Other	
Mark	☒ Passed	☐ Failed	☐ Other	

Alarm Setting						
Gas	High Alarm	Low Alarm		Gas	High Alarm	Low Alarm
CO	75ppm	37ppm		O2	22%VOL	19.5%VOL
H2S	15ppm	7ppm		LEL	10%LEL	5%LEL
CO2	2000ppm	1000ppm				

Calibration						
NO	Calibration gas	Calibration gas concentration	Value before calibration	Value after calibration	Response time(T90)	Remark
1	CO	700ppm	711ppm	700ppm	<30s	
2	H2S	80ppm	83.5ppm	80ppm	<30s	
3	O2	20.9%VOL	22.3%VOL	20.9%VOL	<30s	
4	LEL	60%LEL	57%LEL	60%LEL	<30s	
5	CO2	2000ppm	2010ppm	2000ppm	<30s	

Certification	
We certified that this equipment has been checked, maintained and calibrated according to manufacturer's specification. All reported result were obtained from TISC approved sub-contractor.	
☒ Test Passed	☐ Test Failed
Quality Department	 Tops Instruments Supplies Co. Nash Wei

Appendix F

Meteorological Data

Date		Weather	Total Rainfall (mm)	Lau Fau Shan Station			
				Mean Air Temperature (°C)	Wind Speed (km/h)	Mean Relative Humidity (%)	Wind Direction
1-Jun-26	Mon	Moderate west to southwesterly winds.	Trace	29.8	8.7	77.5	S/SE
2-Jun-26	Tue	Mainly cloudy with more showers later.	0	30.5	15	78.7	W/SW
3-Jun-26	Wed	Light to moderate southwesterly winds.	Trace	31.4	14	76.5	W/SW
4-Jun-26	Thu	Very hot with sunny periods and a few showers.	0.2	30.8	11.5	79.5	W/SW
5-Jun-26	Fri	Extremely hot with sunny periods in the afternoon.	7.5	31.4	20	77.5	SW
6-Jun-26	Sat	Very hot with sunny periods and a few showers.	71.2	28.1	24	88.7	S/SW
7-Jun-26	Sun	Mainly cloudy with more showers later.	10.2	29.6	19	55.5	S/SE
8-Jun-26	Mon	Moderate north to northwesterly winds	109.7	27.5	29	89.5	S/SE
9-Jun-26	Tue	Mainly cloudy with a few showers.	0.3	25.8	17.5	86.2	NW
10-Jun-26	Wed	Mainly cloudy. Sunny intervals	0	26.4	11.7	77.5	E/NE
11-Jun-26	Thu	Mainly cloudy with a few showers.	0.4	27.9	19.2	79.5	E/NE
12-Jun-26	Fri	More showers and a few thunderstorms	Trace	27.8	15	81.7	E
13-Jun-26	Sat	Moderate south to southeasterly winds	27	27.9	19.7	88.7	S/SE
14-Jun-26	Sun	Very hot with sunny periods and a few showers.	23.4	29	23.5	92	SW
15-Jun-26	Mon	Mainly cloudy with a few showers.	122.6	27.8	3.4	90.5	SW
16-Jun-26	Tue	Moderate to fresh southerly winds	119.3	25	13	100	S/SE
17-Jun-26	Wed	Cloudy with heavy showers and squally thunderstorms.	2.6	26	18	93.2	S/SE
18-Jun-26	Thu	Cloudy with heavy showers and squally thunderstorms.	54.1	25	21.5	97.5	SE
19-Jun-26	Fri	Mainly cloudy with a few showers.	2.2	28.7	19.2	87.5	S
20-Jun-26	Sat	Moderate to fresh southerly winds	1.1	30.1	21.2	81.2	S
21-Jun-26	Sun	fine. Very hot . Moderate south to southwesterly winds.	0	30.6	6.2	76.7	W/SW
22-Jun-26	Mon	fine. Very hot . Moderate south to southwesterly winds.	0	30.5	15.7	80.5	W/SW
23-Jun-26	Tue	Mainly cloudy with a few showers and squally thunderstorms.	0	30.9	18.5	80	SW
24-Jun-26	Wed	fine. Very hot . Moderate south to southwesterly winds.	0	31.2	19	80	S/SW
25-Jun-26	Thu	Mainly cloudy with a few showers and squally thunderstorms.	Trace	30	15.5	81.2	W/SW
26-Jun-26	Fri	Light to moderate southwesterly winds.	14.8	29.6	18	81.2	S/SE
27-Jun-26	Sat	Hot with sunny intervals	Trace	29	13	86.5	S/SE
28-Jun-26	Sun	Light to moderate south to southeasterly winds.	11.8	26.9	12.7	98.7	E/SE
29-Jun-26	Mon	Mainly cloudy with a few showers and isolated thunderstorms.	7.2	29.2	13	83.7	SE
30-Jun-26	Tue	Very hot with sunny periods	14.9	29.3	15.5	81.7	E/NE

Appendix G

Event and Action Plan

Event / Action Plan for Air Quality

Event	Action			
	ET	IEC	SM	Contractor
Action level exceedance for one sample	1. Identify source 2. Inform IEC, SM and Contractor 3. Repeat measurements to confirm findings. 4. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily	1. Check monitoring data and Contractor's working methods	1. Notify Contractor for the identification of cause	1. Rectify any unacceptable practice 2. Amend working methods if appropriate
Action level exceedance for two or more consecutive samples	1. Identify source 2. Notify IEC, SM and Contractor 3. Repeat measurements to confirm findings. 4. Investigate the cause of exceedance and check Contractor's working procedures 5. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily. 6. Discuss with IEC and SM on remedial actions required 7. If exceedance continues, arrange meeting with IEC and Contractor 8. If exceedance stops, cease additional monitoring.	1. Review monitoring data submitted by ET 2. Review the investigation finding submitted by ET and check the Contractor's working method 3. Review the proposed remedial measures by Contractor and advise SM accordingly 4. Supervise Implementation of remedial measures.	1. Confirm receipt of notification of exceedance in writing 2. Require Contractor to propose remedial measures for the analysed dust problem 3. Ensure remedial measures properly implemented.	1. Rectify any unacceptable practice 2. Amend working methods if appropriate 3. Submit proposals for remedial actions to IEC within 3 working days of notification 4. Implement the agreed proposals 5. Amend proposal if appropriate.
Limit level exceedance for one sample	1. Identify source 2. Inform IEC, SM and Contractor 3. Repeat measurements to confirm findings. 4. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SM informed of the results	1. Review monitoring data submitted by ET 2. Discuss amongst SM, ET Leader and Contractor on the potential remedial actions. 3. Supervise the implementation of remedial measures	1. Confirm receipt of notification of exceedance in writing 2. Require Contractor to propose remedial measures for the analysed dust problem 3. Ensure remedial measures properly implemented	1. Take immediate action to avoid further exceedance 2. Submit proposals for remedial actions to IEC within 3 working days of notification 3. Implement the agreed proposals 4. Amend proposal if appropriate
Limit level exceedance for two or more consecutive samples	1. Identify source 2. Repeat measurements to confirm findings 3. Inform IEC, SM, Contractor and EPD 4. Investigate the cause of exceedance and carry out analysis of Contractor's	1. Review monitoring data submitted by ET 2. Discuss amongst SM, ET Leader and Contractor on	1. Confirm receipt of notification of exceedance in writing 2. Require Contractor to propose remedial	1. Take immediate action to avoid further exceedance; 2. Submit proposals for remedial actions to IEC within 3 working

Event	Action			
	ET	IEC	SM	Contractor
	working procedures to determine possible mitigation to be implemented 5. If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to daily. 6. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SM informed of the results 7. If exceedance continues, arrange meeting with IEC and Contractor 8. If exceedance stops, cease additional monitoring.	the potential remedial actions. 3. Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise SM accordingly 4. Supervise the implementation of remedial measures.	measures for the analysed dust problem 3. Ensure remedial measures properly implemented; 4. If exceedance continues, consider what activity of the work is responsible and instruct Contractor to stop that activity of work until the exceedance is abated	days of notification; 3. Implement the agreed proposals; 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the SM until the exceedance is abated.

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager

Event / Action Plan for Construction Noise

Event	ET	IEC	SM	Contractor
Exceedance of Action Level	Identify source, investigate the causes of exceedance and propose remedial measures; Notify IEC and Contractor; Report the results of investigation to IEC, SM and Contractor; Discuss with Contractor and formulate remedial measures; If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency to check mitigation effectiveness.	Review the analysed results submitted by ET; Review the proposed Remedial measures by Contractor and advise SM accordingly; Supervise the implementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented.	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.
Exceedance of Limit Level	Identify source; Inform IEC, SM, EPD and Contractor; Repeat measurements to confirm findings; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; If the exceedance is confirmed to be Project related after investigation, increase monitoring frequency; Inform IEC, SM and EPD the causes and actions taken for exceedance; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and SM informed of the results; If exceedance stops, cease additional monitoring.	Discuss amongst SM, ET, and Contractor on the potential remedial actions; Review Contractor remedial actions whenever necessary to assure their effectiveness and advise SM accordingly; Supervise implementation of remedial measures.	Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct Contractor to stop that portion of works until the exceedance is abated.	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by SM until the exceedance is abated.

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager

Event / Action Plan for Water Quality

Event	ET	IEC	SM	Contractor
Action level being exceeded by one sampling day	- Identify source(s) of impact; - Inform IEC, Contractor; Check monitoring data, all plant, equipment and Contractor's working methods.	Check monitoring data and Contractor's working methods.	- Confirm receipt of notification of non-compliance in writing; and - Notify Contractor.	- Rectify unacceptable practice; and - Amend working methods if appropriate.
Action level being exceeded by two or more consecutive sampling days	- Identify source(s) of impact; - Inform IEC, Contractor; - Check monitoring data, all plant, equipment and Contractor's working methods; Ensure mitigation measures are implemented; - If the exceedance is confirmed to be Project related after investigation, increase the monitoring frequency to daily until no exceedance of Action level	- Check monitoring data and Contractor's working method; - Discuss with ET and Contractor on possible remedial actions; - Review the proposed mitigation measures; and - Supervise the implementation of mitigation measures.	- Discuss with IEC on the proposed mitigation measures; - Ensure mitigation measures are properly implemented; and - Assess the effectiveness of the implemented mitigation measures	- Rectify unacceptable practice; - Check all plant and equipment and consider changes of working methods; - Submit proposal of additional mitigation measures to IEC within 3 working days of notification; and - Implement the agreed mitigation measures.
Limit level being exceeded by one sampling day	- Identify source(s) of impact; - Inform IEC, SM and Contractor; - Check monitoring data, all plant, equipment and Contractor's working methods; - Discuss mitigation measures with IEC, SM and Contractor; Ensure mitigation measures are implemented; and - If the exceedance is confirmed to be Project related after investigation, repeat measurement on next day of exceedance.	- Check monitoring data submitted by ET and Contractor's working method; - Discuss with ET and Contractor on possible remedial actions; - Review the proposed mitigation measures submitted by Contractor and advise the SM accordingly.	- Confirm receipt of notification of failure in writing; - Discuss with IEC, ET and Contractor on the proposed mitigation measures; - Request Contractor to review the working methods.	- Take immediate corrective actions to avoid further exceedance; - Submit proposal of mitigation measures to IEC within 3 working days; - Implement the agreed mitigation measures; - Submit further mitigation measures if problem still not under control;

Event	ET	IEC	SM	Contractor
Limit level being exceeded by two or more consecutive sampling days	- Identify source(s) of impact; - Inform IEC, SM, EPD - Check monitoring data, all plant, equipment and - Contractor's working methods; Discuss mitigation measures with IEC, SM and Contractor; - Ensure mitigation measures are implemented; - If the exceedance is confirmed to be Project related after investigation, increase the monitoring frequency to daily until no exceedance of Limit level	- Check monitoring data submitted by ET and Contractor's working method; Discuss with ET and Contractor on possible remedial actions; - Review the - Contractor's mitigation measures - whenever - necessary to assure their effectiveness; - Supervise the implementation of mitigation measures.	- Discuss with IEC, ET and Contractor on the proposed mitigation measures; - Request Contractor to critically review the working methods; - Make agreement on the mitigation measures and ensure mitigation measures are properly implemented; - Consider and instruct, if necessary, to slow down or stop that activity of work until exceedance is abated.	- Take immediate corrective actions to avoid further exceedance; - Submit proposal of mitigation measures to IEC within 3 working days; - Implement the agreed mitigation measures; Resubmit proposals if problem still not under control; - Slow down or to stop relevant activity until exceedance is abated.

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager

Event and action plan for landscape and visual monitoring during Construction

	ET	IEC	SM	Contractor
Design checking	Check final design conforms to the requirements of EP and prepare report	Check report. Recommend remedial design if necessary	Undertake remedial design if necessary	Ensure compliance with EP requirements
Exceedance on one occasion	Identify source of impact Inform IEC and SM Discuss remedial actions with IEC, SM and Contractor Monitor remedial actions until rectification has been completed	• Check monitoring report • Check Contractor's working method • Discuss with ET and Contractor on possible remedial measures • Advise SM on effectiveness of proposed remedial measures • Check implementation of remedial measures	• Notify Contractor • Ensure remedial measures are properly implemented	• Amend working methods • Rectify damage and undertake any necessary replacement
Repeated Exceedance(s)	• Identify source of impact • Inform IEC and SM • Increase monitoring frequency • Discuss remedial actions with IEC, SM and Contractor • Monitor remedial actions until rectification has been completed • If exceedance stops, cease additional monitoring	• Check monitoring report • Check Contractor's working method • Discuss with ET and Contractor on possible remedial measures • Advise SM on effectiveness of proposed remedial measures • Supervise implementation of remedial measures	• Notify Contractor • Ensure remedial measures are properly implemented	• Amend working methods • Rectify damage and undertake any necessary replacement

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager

Event Action Plan for Landfill Gas Monitoring

Event	ET Leader	IEC	SM	Contractor
Limit level being exceeded for Field monitoring at the perimeter monitoring wells	- Investigate the cause(s) of exceedance; - Check monitoring data, all plant, equipment and the Contractor's working methods; - Inform Contractor, IEC, SM and EPD (EIAO Authority) whether the cause of exceedance is due to the Project; - Discuss with Contractor and IEC for remedial measures required; - Ensure remedial measures are properly implemented; and - Increase the monitoring frequency to daily if exceedance is due to the Project for monitoring wells in the areas where there is development within 250m of the WENTX Site Boundary and to weekly for other monitoring wells, until no exceedance of limit level	- Discuss with ET and Contractor on proposed remedial measures; - Review proposals on remedial measures; and - Supervise the implementation of remedial measures	- Confirm receipt of notification in writing; - Required Contractor to propose remedial measures; - Ensure remedial measure are properly implemented.	- Repeat field measurement to confirm findings; - Check the performance of landfill gas management system; - Rectify unacceptable practice; - Discuss with the ET and IEC and submit proposals for remedial measures to IEC; - Implement the agreed proposals; and - Amend proposal if appropriate
Limit level being exceeded for Bulk gas sampling at the perimeter monitoring wells	- Check and compare the results of field monitoring and laboratory analyse of bulk samples; - If the results of field monitoring also show exceedance, the action(s) for limit level being exceeded for field monitoring would have been triggered; - If the results of field monitoring does not show exceedance, the sampling procedures should be checked and if deems necessary, to repeat the monitoring and recalibrate the portable monitoring instruments; and - Notify the above findings to Contractor and IEC	Verify the findings by ET	- Confirm receipt of notification in writing; - Required Contractor to propose remedial measures; - Ensure remedial measure are properly implemented.	Nil
Limit level being exceeded for permanent gas monitoring system	- Investigate the cause(s) of exceedance; - Check the methane gas level at the perimeter monitoring wells, manholes or utilities duct; - Check monitoring data, all plant, equipment and the Contractor's working methods; - Inform Contractor, IEC, SM and EPD (EIAO Authority) whether the cause of exceedance is due to the Project; - Discuss with Contractor and IEC for remedial measures required; and - Ensure remedial measures are properly implemented	- Discuss with ET and Contractor on proposed remedial measures; - Review proposals on remedial measures; and - Supervise the implementation of remedial measures	- Confirm receipt of notification in writing; - Required Contractor to propose remedial measures; - Ensure remedial measure are properly implemented.	- Evacuate all staff in the concerned building; - Open the doors and window of all rooms on the ground floor; - Do not allow staff to go back to the room if methane level is higher than 1% gas; - Check the performance of the landfill gas management system; - Rectify unacceptable practice;

Event	ET Leader	IEC	SM	Contractor
				- Consider changes of working methods; - Discuss with the ET and IEC and submit proposals for remedial measures to IEC; - Implement the agreed proposals; and - Amend proposal if appropriate
Limit level being exceeded for surface emission monitoring	- Repeat the measurement to confirm findings; - Investigate the cause(s) of exceedance; - Check monitoring data, all plant, equipment and the Contractor's working methods; - Inform Contractor, IEC, SM and EPD (EIAO Authority) whether the cause of exceedance is due to the Project; - Discuss with Contractor and IEC for remedial measures required; - Ensure remedial measures are properly implemented; and - Increase the monitoring frequency to monthly if exceedance is due to the Project until no exceedance of limit level	- Discuss with ET and Contractor on proposed remedial measures; - Review proposals on remedial measures; and - Supervise the implementation of remedial measures	- Confirm receipt of notification in writing; - Required Contractor to propose remedial measures; - Ensure remedial measure are properly implemented.	- Check landfill gas management system; - Rectify unacceptable practice; - Consider changes of working methods; - Discuss with the ET and IEC and submit proposals for remedial measures to IEC; - Implement the agreed proposals; and - Amend proposal if appropriate
Limit level being exceeded at the service voids, utilities pits, manholes and location of vegetation stress	- Repeat the measurement to confirm findings; - Investigate the cause(s) of exceedance; - Check monitoring data, all plant, equipment and the Contractor's working methods; - Inform Contractor, IEC, SM and EPD (EIAO Authority) whether the cause of exceedance is due to the Project; - Discuss with Contractor and IEC for remedial measures required; - Ensure remedial measures are properly implemented; and - Increase the monitoring frequency to weekly if exceedance is due to the Project until no exceedance of limit level	- Discuss with ET and Contractor on proposed remedial measures; - Review proposals on remedial measures; and - Supervise the implementation of remedial measures	- Confirm receipt of notification in writing; - Required Contractor to propose remedial measures; - Ensure remedial measure are properly implemented.	- Check landfill gas management system; - Rectify unacceptable practice; - Discuss with the ET and IEC and submit proposals for remedial measures to IEC; - Implement the agreed proposals; and - Amend proposal if appropriate

Notes:

ET – Environmental Team

IEC – Independent Environmental Checker

SM – Service Manager

Appendix H

Monitoring Schedule

Impact Monitoring Schedule for June 2026

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
	1	2	3	4	5	6
		1-Hr TSP X3 24-Hr TSP	Noise	1-Hr TSP X3 24-Hr TSP	Surface Water	1-Hr TSP X3 24-Hr TSP
7	8	9	10	11	12	13
			1-Hr TSP X3 24-Hr TSP	Noise	1-Hr TSP X3 24-Hr TSP	
14	15	16	17	18	19	20
	Noise	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP		
21	22	23	24	25	26	27
	1-Hr TSP X3 24-Hr TSP	Noise				1-Hr TSP X3 24-Hr TSP
28	29	30				
		1-Hr TSP X3 24-Hr TSP				

Impact Monitoring Schedule for July 2026

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			1	2	3	4
				Noise	1-Hr TSP X3 24-Hr TSP	
5	6	7	8	9	10	11
	Noise Surface Water	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP		
12	13	14	15	16	17	18
	1-Hr TSP X3 24-Hr TSP	Noise	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP	
19	20	21	22	23	24	25
	Noise	1-Hr TSP X3 24-Hr TSP		1-Hr TSP X3 24-Hr TSP		
26	27	28	29	30	31	
	1-Hr TSP X3 24-Hr TSP	Noise	1-Hr TSP X3 24-Hr TSP			

Appendix I

Detailed Monitoring Results

Construction Dust Monitoring Results

Location: AM(D)1

Date	Start Time	1-hour TSP ($\mu\text{g}/\text{m}^3$)			Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level($\mu\text{g}/\text{m}^3$)
		1 st reading	2 nd reading	3 rd reading		
2-Jun-26	11:30	125	118	143	317	500
4-Jun-26	11:28	82	91	106	317	500
6-Jun-26	11:33	76	43	59	317	500
10-Jun-26	11:27	66	40	55	317	500
12-Jun-26	15:30	76	76	41	317	500
16-Jun-26	11:25	77	53	68	317	500
18-Jun-26	11:33	61	43	74	317	500
22-Jun-26	11:25	153	141	140	317	500
27-Jun-26	11:34	70	55	61	317	500
30-Jun-26	11:27	61	49	57	317	500

Location: AM(D)2

Date	Start Time	1-hour TSP ($\mu\text{g}/\text{m}^3$)			Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level($\mu\text{g}/\text{m}^3$)
		1 st reading	2 nd reading	3 rd reading		
2-Jun-26	10:55	76	80	67	313	500
4-Jun-26	10:58	55	58	49	313	500
6-Jun-26	11:04	73	46	61	313	500
10-Jun-26	10:55	59	52	40	313	500
12-Jun-26	15:03	77	52	63	313	500
16-Jun-26	10:55	65	50	57	313	500
18-Jun-26	11:02	76	52	88	313	500
22-Jun-26	11:07	61	53	76	313	500
27-Jun-26	10:55	91	76	76	313	500
30-Jun-26	11:02	54	64	49	313	500

Location: AM(D)3

Date	Start Time	1-hour TSP ($\mu\text{g}/\text{m}^3$)			Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level($\mu\text{g}/\text{m}^3$)
		1 st reading	2 nd reading	3 rd reading		
2-Jun-26	10:33	135	101	133	334	500
4-Jun-26	10:28	41	69	51	334	500
6-Jun-26	10:31	47	47	37	334	500
10-Jun-26	10:34	71	88	85	334	500
12-Jun-26	14:31	61	53	58	334	500
16-Jun-26	10:30	45	50	55	334	500
18-Jun-26	10:33	37	45	31	334	500
22-Jun-26	10:27	45	37	49	334	500
27-Jun-26	10:33	37	41	33	334	500
30-Jun-26	10:27	61	53	59	334	500

Location: AM(D)5a

Date	Start Time	1-hour TSP ($\mu\text{g}/\text{m}^3$)			Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level($\mu\text{g}/\text{m}^3$)
		1 st reading	2 nd reading	3 rd reading		
2-Jun-26	09:03	212	163	183	371	500
4-Jun-26	08:49	222	183	217	371	500
6-Jun-26	09:03	82	95	108	371	500
10-Jun-26	08:57	92	79	98	371	500
12-Jun-26	12:57	117	138	111	371	500
16-Jun-26	08:37	63	49	53	371	500
18-Jun-26	08:55	41	92	86	371	500
22-Jun-26	09:02	232	203	267	371	500
27-Jun-26	08:57	144	183	175	371	500
30-Jun-26	09:00	154	162	174	371	500

Location: AM(D)6a

Date	Start Time	1-hour TSP ($\mu\text{g}/\text{m}^3$)			Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level($\mu\text{g}/\text{m}^3$)
		1 st reading	2 nd reading	3 rd reading		
2-Jun-26	09:33	131	138	144	294	500
4-Jun-26	09:35	86	95	88	294	500
6-Jun-26	09:30	38	49	49	294	500
10-Jun-26	09:28	80	93	88	294	500
12-Jun-26	13:32	40	45	45	294	500
16-Jun-26	09:34	45	74	65	294	500
18-Jun-26	09:30	38	50	49	294	500
22-Jun-26	09:33	84	65	57	294	500
27-Jun-26	09:27	43	59	62	294	500
30-Jun-26	09:32	38	52	44	294	500

Location: AM(D)7b

Date	Start Time	1-hour TSP ($\mu\text{g}/\text{m}^3$)			Action Level ($\mu\text{g}/\text{m}^3$)	Limit Level($\mu\text{g}/\text{m}^3$)
		1 st reading	2 nd reading	3 rd reading		
2-Jun-26	10:06	48	56	59	331	500
4-Jun-26	10:02	44	68	52	331	500
6-Jun-26	10:10	50	34	40	331	500
10-Jun-26	10:02	40	60	48	331	500
12-Jun-26	14:00	42	58	54	331	500
16-Jun-26	10:07	44	40	51	331	500
18-Jun-26	10:00	50	32	46	331	500
22-Jun-26	10:03	106	78	90	331	500
27-Jun-26	10:11	56	38	40	331	500
30-Jun-26	09:55	39	42	50	331	500

24-Hour TSP Monitoring Data for AM(D)1

DATE	SAMPLE NUMBER	ELAPSED TIME			CHART READING			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER WEIGHT (g)		DUST WEIGHT COLLECTED	24-hr TSP (µg/m³)	Action Level	Limit Level
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m³)	INITIAL	FINAL	(g)			
2 Jun 26	22483	24052.55	24076.55	1440.00	38	38	38.0	30	1006.7	1.15	1661	2.6542	2.8375	0.1833	110	155	260
4 Jun 26	22491	24076.55	24100.55	1440.00	38	38	38.0	30.8	1003.3	1.15	1655	2.6492	2.7880	0.1388	84	155	260
6 Jun 26	22487	24100.55	24124.55	1440.00	37	38	37.5	27.7	1006.1	1.14	1643	2.6408	2.7058	0.0650	40	155	260
10 Jun 26	22495	24124.55	24148.55	1440.00	36	36	36.0	26.3	1008.5	1.09	1574	2.6631	2.7236	0.0605	38	155	260
12 Jun 26	22555	24148.55	24172.55	1440.00	36	37	36.5	27.4	1012.4	1.11	1599	2.6337	2.7137	0.0800	50	155	260
16 Jun 26	22559	24172.55	24196.55	1440.00	35	36	35.5	26.1	1007.6	1.08	1553	2.6444	2.6831	0.0387	25	155	260
18 Jun 26	22568	24196.55	24220.55	1440.00	36	36	36.0	27.1	1009.3	1.09	1576	2.6360	2.7260	0.0900	57	155	260
22 Jun 26	22572	24220.55	24244.55	1440.00	36	36	36.0	30.2	1006.6	1.09	1564	2.6380	2.8374	0.1994	127	155	260
27 Jun 26	22579	24244.55	24268.55	1440.00	34	35	34.5	28.9	1005.3	1.04	1493	2.6511	2.6990	0.0479	32	155	260
30 Jun 26	22586	24268.55	24292.55	1440.00	34	34	34.0	28.7	1008.2	1.02	1472	2.6668	2.6994	0.0326	22	155	260

24-Hour TSP Monitoring Data for AM(D)2

DATE	SAMPLE NUMBER	ELAPSED TIME			CHART READING			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER WEIGHT (g)		DUST WEIGHT COLLECTED	24-hr TSP (µg/m³)	Action Level	Limit Level
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m³)	INITIAL	FINAL	(g)			
2 Jun 26	22476	12942.55	12966.55	1440.00	36	36	36.0	30	1006.7	1.14	1635	2.6650	2.7497	0.0847	52	156	260
4 Jun 26	22492	12966.55	12990.55	1440.00	36	37	36.5	30.8	1003.3	1.15	1654	2.6630	2.7253	0.0623	38	156	260
6 Jun 26	22477	12990.55	13014.55	1440.00	36	36	36.0	27.7	1006.1	1.14	1641	2.6592	2.7150	0.0558	34	156	260
10 Jun 26	22496	13014.55	13038.55	1440.00	36	36	36.0	26.3	1008.5	1.14	1647	2.6615	2.6958	0.0343	21	156	260
12 Jun 26	22556	13038.55	13062.55	1440.00	36	36	36.0	27.4	1012.4	1.14	1647	2.6394	2.7111	0.0717	44	156	260
16 Jun 26	22560	13062.55	13086.55	1440.00	36	36	36.0	26.1	1007.6	1.14	1647	2.6443	2.6866	0.0423	26	156	260
18 Jun 26	22564	13086.55	13110.55	1440.00	35	36	35.5	27.1	1009.3	1.13	1623	2.6347	2.6835	0.0488	30	156	260
22 Jun 26	22573	13110.55	13134.55	1440.00	36	36	36.0	30.2	1006.9	1.14	1635	2.6350	2.7158	0.0808	49	156	260
27 Jun 26	22580	13134.55	13158.55	1440.00	34	34	34.0	28.9	1005.3	1.07	1545	2.6411	2.6912	0.0501	32	156	260
30 Jun 26	22587	13158.55	13182.55	1440.00	34	34	34.0	28.7	1008.2	1.07	1547	2.6609	2.6958	0.0349	23	156	260

24-Hour TSP Monitoring Data for AM(D)3																	
DATE	SAMPLE NUMBER	ELAPSED TIME			CHART READING			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER WEIGHT (g)		DUST WEIGHT COLLECTED	24-hr TSP (µg/m³)	Action Level	Limit Level
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m³)	INITIAL	FINAL	(g)			
2 Jun 26	22478	25157.75	25181.75	1440.00	38	38	38.0	30	1006.7	1.13	1624	2.6465	2.8070	0.1605	99	155	260
4 Jun 26	22493	25181.75	25205.75	1440.00	36	37	36.5	30.8	1003.3	1.07	1544	2.6518	2.7138	0.0620	40	155	260
6 Jun 26	22469	25205.75	25229.75	1440.00	37	37	37.0	27.7	1006.1	1.10	1581	2.6556	2.7065	0.0509	32	155	260
10 Jun 26	22490	25229.75	25253.75	1440.00	36	36	36.0	26.3	1008.5	1.07	1537	2.6254	2.7252	0.0998	65	155	260
12 Jun 26	22557	25253.75	25277.75	1440.00	36	36	36.0	27.4	1012.4	1.07	1537	2.6427	2.6916	0.0489	32	155	260
16 Jun 26	22554	25277.75	25301.75	1440.00	36	36	36.0	26.1	1007.6	1.10	1586	2.6430	2.6990	0.0560	35	155	260
18 Jun 26	22566	25301.75	25325.75	1440.00	36	36	36.0	27.1	1009.3	1.10	1584	2.6372	2.6639	0.0267	17	155	260
22 Jun 26	22571	25325.75	25349.75	1440.00	36	36	36.0	30.2	1006.9	1.09	1573	2.6306	2.6823	0.0517	33	155	260
27 Jun 26	22581	25349.75	25373.75	1440.00	34	34	34.0	28.9	1005.3	1.02	1474	2.6484	2.6688	0.0204	14	155	260
30 Jun 26	22584	25373.75	25397.75	1440.00	34	35	34.5	28.7	1008.2	1.04	1502	2.6514	2.6996	0.0482	32	155	260

24-Hour TSP Monitoring Data for AM(D)5a																	
DATE	SAMPLE NUMBER	ELAPSED TIME			CHART READING			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER WEIGHT (g)		DUST WEIGHT COLLECTED	24-hr TSP (µg/m³)	Action Level	Limit Level
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m³)	INITIAL	FINAL	(g)			
2 Jun 26	22486	6879.31	6903.31	1440.00	38	38	38.0	30	1006.7	1.15	1658	2.6437	2.9158	0.2721	164	238	260
4 Jun 26	22494	6903.31	6927.31	1440.00	37	38	37.5	30.8	1003.3	1.13	1627	2.6413	2.9381	0.2968	182	238	260
6 Jun 26	22484	6927.31	6951.31	1440.00	38	38	38.0	27.7	1006.1	1.16	1665	2.6550	2.7468	0.0918	55	238	260
10 Jun 26	22497	6951.31	6975.31	1440.00	38	38	38.0	26.3	1008.5	1.16	1671	2.6675	2.7939	0.1264	76	238	260
12 Jun 26	22500	6975.31	6999.31	1440.00	37	38	37.5	27.4	1012.4	1.14	1646	2.6487	2.8251	0.1764	107	238	260
16 Jun 26	22561	6999.31	7023.31	1440.00	35	36	35.5	26.1	1007.6	1.05	1511	2.6326	2.6955	0.0629	42	238	260
18 Jun 26	22569	7023.31	7047.31	1440.00	34	34	34.0	27.1	1009.3	1.00	1436	2.6385	2.7228	0.0843	59	238	260
22 Jun 26	22574	7047.31	7071.31	1440.00	36	36	36.0	30.2	1006.9	1.06	1523	2.6393	2.9245	0.2852	187	238	260
27 Jun 26	22577	7071.31	7095.31	1440.00	36	36	36.0	28.9	1005.3	1.06	1526	2.6482	2.8350	0.1868	122	238	260
30 Jun 26	22588	7095.31	7119.31	1440.00	36	36	36.0	28.7	1008.2	1.06	1529	2.6514	2.8368	0.1854	121	238	260

24-Hour TSP Monitoring Data for AM(D)6a																	
DATE	SAMPLE NUMBER	ELAPSED TIME			CHART READING			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER WEIGHT (g)		DUST WEIGHT COLLECTED	24-hr TSP (µg/m³)	Action Level	Limit Level
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m³)	INITIAL	FINAL	(g)			
2 Jun 26	22482	24880.98	24904.98	1440.00	38	38	38.0	30	1006.7	1.21	1736	2.6572	2.8708	0.2136	123	159	260
4 Jun 26	22485	24904.98	24928.98	1440.00	36	37	36.5	30.8	1003.3	1.15	1655	2.6567	2.7551	0.0984	59	159	260
6 Jun 26	22479	24928.98	24952.98	1440.00	38	38	38.0	27.7	1006.1	1.21	1743	2.6541	2.7077	0.0536	31	159	260
10 Jun 26	22498	24952.98	24976.98	1440.00	38	38	38.0	26.3	1008.5	1.21	1750	2.6617	2.7860	0.1243	71	159	260
12 Jun 26	22552	24976.98	25000.98	1440.00	38	38	38.0	27.4	1012.4	1.22	1750	2.6305	2.7350	0.1045	60	159	260
16 Jun 26	22562	25000.98	25024.98	1440.00	36	36	36.0	26.1	1007.6	1.14	1647	2.6321	2.6777	0.0456	28	159	260
18 Jun 26	22567	25024.98	25048.98	1440.00	36	36	36.0	27.1	1009.3	1.14	1646	2.6337	2.6856	0.0519	32	159	260
22 Jun 26	22575	25048.98	25072.98	1440.00	36	36	36.0	30.2	1006.9	1.13	1634	2.6416	2.7288	0.0872	53	159	260
27 Jun 26	22582	25072.98	25096.98	1440.00	36	36	36.0	28.9	1005.3	1.14	1637	2.6466	2.7070	0.0604	37	159	260
30 Jun 26	22589	25096.98	25120.98	1440.00	36	36	36.0	28.7	1008.2	1.14	1640	2.6437	2.6836	0.0399	24	159	260

24-Hour TSP Monitoring Data for AM(D)7b																	
DATE	SAMPLE NUMBER	ELAPSED TIME			CHART READING			AVG TEMP	AVG AIR PRESS	STANDARD FLOW RATE	AIR VOLUME	FILTER WEIGHT (g)		DUST WEIGHT COLLECTED	24-hr TSP (µg/m³)	Action Level	Limit Level
		INITIAL	FINAL	(min)	MIN	MAX	AVG	(°C)	(hPa)	(m³/min)	(std m³)	INITIAL	FINAL	(g)			
2 Jun 26	22480	6519.01	6543.01	1440.00	36	36	36.0	30	1006.7	1.11	1605	2.6569	2.7203	0.0634	39	215	260
4 Jun 26	22489	6543.01	6567.01	1440.00	36	36	36.0	30.8	1003.3	1.11	1600	2.6308	2.6726	0.0418	26	215	260
6 Jun 26	22481	6567.01	6591.01	1440.00	36	36	36.0	27.7	1006.1	1.12	1612	2.6431	2.6856	0.0425	26	215	260
10 Jun 26	22499	6591.01	6615.01	1440.00	36	36	36.0	26.3	1008.5	1.12	1619	2.6566	2.7211	0.0645	40	215	260
12 Jun 26	22553	6615.01	6639.01	1440.00	34	34	34.0	27.4	1012.4	1.05	1513	2.6322	2.6793	0.0471	31	215	260
16 Jun 26	22570	6639.01	6663.01	1440.00	33	34	33.5	26.1	1007.6	1.04	1497	2.6195	2.6725	0.0530	35	215	260
18 Jun 26	22563	6663.01	6687.01	1440.00	34	34	34.0	27.1	1009.3	1.06	1520	2.6361	2.6577	0.0216	14	215	260
22 Jun 26	22576	6687.01	6711.01	1440.00	36	36	36.0	30.2	1006.9	1.12	1608	2.6469	2.7869	0.1400	87	215	260
27 Jun 26	22591	6711.01	6735.01	1440.00	34	35	34.5	28.9	1005.3	1.07	1536	2.6496	2.6762	0.0266	17	215	260
30 Jun 26	22590	6735.01	6759.01	1440.00	34	34	34.0	28.7	1008.2	1.05	1515	2.6500	2.6783	0.0283	19	215	260

Construction Noise Monitoring Results

Location: NM1
(Daytime Period)

Date	Start Time	1 st Leq _{5min}	L10	L90	2 nd Leq _{5min}	L10	L90	3 rd Leq _{5min}	L10	L90	4 th Leq _{5min}	L10	L90	5 th Leq _{5min}	L10	L90	6 th Leq _{5min}	L10	L90	Leq _{30min}	Façade Correction	Limit Level
3-Jun-26	14:27	49.6	51.0	47.8	49.9	51.6	47.6	49.1	50.6	47.4	49.7	51.0	47.4	49.6	51.4	47.4	49.8	50.7	47.5	50	53	75
11-Jun-26	15:59	48.1	50.3	40.5	48.2	50.3	41.4	46.5	49.5	41.9	45.6	48.3	41.4	44.9	47.0	40.6	45.6	49.1	41.0	47	50	75
15-Jun-26	13:12	53.5	55.4	51.1	54.9	55.6	54.0	56.5	57.8	54.9	55.6	56.6	54.0	57.4	58.7	55.7	55.2	56.4	53.7	56	59	75
23-Jun-26	15:22	51.0	52.4	48.5	50.1	52.1	47.9	48.8	50.7	46.5	49.5	51.3	46.9	49.6	51.5	47.2	50.4	52.4	47.1	50	53	75

Remark: façade correction +3 dB(A) was added according to acoustical principles and EPD guidelines

Surface Water Quality Monitoring Results
Location: WM1

Date	Time	Tide	Depth (m)	Speed of Water Flow (m/s)	Direction of Water Flow (degree)	Temp (°C)		DO (mg/L)		DOS (%)		Turbidity (NTU)		Salinity (ppt)		pH		Conductivity (µS/cm)		Suspended Solids (mg/L)	
5-Jun-26	15:55	Ebb	1.20	0.251	57.60	33.0	33.0	9.51	9.6	143.0	143.8	9.29	9.6	14.34	14.37	8.18	8.2	27552	27592	10.8	10.7
						33.0		9.62		144.6		9.82		14.39		8.15		27632		10.6	
5-Jun-26	10:17	Flood	1.70	0.631	215.00	29.5	29.5	6.71	6.7	92.6	92.4	10.38	10.2	17.65	17.70	7.75	7.7	31241	31306	9.2	9.1
						29.4		6.68		92.1		10.04		17.75		7.74		31370		8.9	

Total Alkalinity (mg/L)		Sulphate (mg/L)		Chloride (mg/L)		Cadmium (µg/L)		Copper (µg/L)		Lead (µg/L)		Manganese (µg/L)		Nickel (µg/L)		Zinc (µg/L)		Calcium (µg/L)		Iron (µg/L)		Magnesium (µg/L)		Potassium (µg/L)		Sodium (µg/L)	
88	87.5	952	991.0	6880	7035.0	<0.2	<0.2	1.00	1.0	<1	<1	37.00	36.5	<1	#DIV/0!	<10	<10	194000	199500	180	180	465000	467500	150000	150000	3720000	3730000
87		1030		7190		<0.2		1.00		<1		36.00		<1		<10		205000		180		470000		150000		3740000	
89	89.5	1140	1120.0	8430	8400.0	<0.2	<0.2	2.00	2.0	<1	<1	21.00	22.0	1.0	1.0	<10	<10	228000	224000	240	235	544000	534500	173000	170000	4270000	4200000
90		1100		8370		<0.2		2.00		<1		23.00		1.0		<10		220000		230		525000		167000		4130000	

Ammonia as N (mg/L)		Nitrate as N (mg/L)		Total Kjeldahl Nitrogen as N (mg/L)		Reactive Phosphorus as P (mg/L)		Sulphite (mg/L)		Total Organic Carbon (mg/L)		Oil and Grease (mg/L)		Chemical Oxygen Demand (COD) (mg/L)		Biochemical Oxygen (mg/L)		Total Coliform (CFU/100mL)	
<0.01	<0.01	0.61	0.605	0.4	0.45	<0.01	<0.01	<2	<2	<5	<5	<5	<5	<20	<20	<2	<2	170	145.0
<0.01		0.60		0.5		<0.01		<2		<5		<5		<20		<2		120	
0.08	0.075	0.89	0.885	0.6	0.55	0.02	0.020	<2	<2	<5	<5	<5	<5	<20	<20	<2	<2	9	8.0
0.07		0.88		0.5		0.02		<2		<5		<5		<20		<2		7	

Landfill Gas Monitoring - Field Measurement Recording Sheet

Contract No.: EP/SP/186/21
Name of construction site: West New Territories Landfill Extension
Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	10-Dec-25
SKY3000 Series (LEL)	30-Jan-26

Date of measurement	Sample location	Sampling time	Monitoring of Excavation						
			Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (°C)	Remark
1-Jun-26	C1	8: 32	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	B2	8: 51	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	B9	9: 10	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	B10	9: 12	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	B1a	9: 25	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	B1c	9: 39	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	L60	9: 58	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	A1	9: 58	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	C1	13: 29	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
1-Jun-26	B2	13: 49	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
1-Jun-26	B9	13: 59	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
1-Jun-26	B10	14: 16	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
1-Jun-26	B1a	14: 34	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
1-Jun-26	B1c	14: 53	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
1-Jun-26	L60	14: 58	Cloudy	0.0%	0	20.4	0%LEL	29.2℃	
1-Jun-26	A1	15: 16	Cloudy	0.0%	0	20.4	0%LEL	32.3℃	
2-Jun-26	C1	8: 31	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	B2	8: 49	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	B9	9: 12	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	B10	9: 19	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	B1a	9: 34	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	B1c	9: 53	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	L60	9: 58	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	A1	10: 14	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	C1	13: 30	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
2-Jun-26	B2	13: 48	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
2-Jun-26	B9	14: 14	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
2-Jun-26	B10	14: 20	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
2-Jun-26	B1a	14: 37	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
2-Jun-26	B1c	14: 59	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
2-Jun-26	L60	14: 58	Sunny	0.0%	0	20.4	0%LEL	30℃	
2-Jun-26	A1	15: 13	Sunny	0.0%	0	20.4	0%LEL	33.3℃	
3-Jun-26	C1	8: 28	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	B2	8: 44	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	B9	9: 12	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	B10	9: 27	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	B1a	9: 41	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	B1c	9: 51	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	L60	9: 58	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	A1	10: 16	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	C1	13: 35	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
3-Jun-26	B2	13: 52	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
3-Jun-26	B9	14: 12	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
3-Jun-26	B10	14: 22	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
3-Jun-26	B1a	14: 40	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
3-Jun-26	B1c	14: 53	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
3-Jun-26	L60	15: 58	Cloudy	0.0%	0	20.2	0%LEL	30.5℃	
3-Jun-26	A1	15: 19	Cloudy	0.0%	0	20.2	0%LEL	34.3℃	
4-Jun-26	C1	8: 29	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	B2	8: 48	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	B9	9: 5	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	B10	9: 19	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	B1a	9: 37	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	B1c	9: 54	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	A1	10: 15	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	L60	10: 29	Sunny	0.0%	0	20.5	0%LEL	30.8℃	
4-Jun-26	C1	13: 29	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	B2	13: 47	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	B9	14: 10	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	B10	14: 23	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	B1a	14: 39	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	B1c	14: 57	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	A1	15: 18	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
4-Jun-26	L60	15: 31	Sunny	0.0%	0	20.5	0%LEL	34.2℃	
5-Jun-26	C1	8: 28	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	B2	8: 47	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	B9	9: 8	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	B10	9: 27	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	B1a	9: 48	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	B1c	10: 12	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	A1	10: 21	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	L60	10: 38	Cloudy	0.0%	0	20.5	0%LEL	30.7℃	
5-Jun-26	C1	13: 31	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	B2	13: 49	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	B9	14: 15	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	B10	14: 28	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	B1a	14: 45	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	B1c	15: 10	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	A1	15: 18	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
5-Jun-26	L60	15: 35	Cloudy	0.0%	0	20.5	0%LEL	34.6℃	
6-Jun-26	C1	8: 29	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	B2	8: 51	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	B9	9: 11	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	B10	9: 27	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	B1a	9: 45	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	B1c	9: 59	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	A1	10: 18	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	L60	10: 31	Rainy	0.0%	0	20.3	0%LEL	27.7℃	
6-Jun-26	C1	13: 29	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	B2	13: 47	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	B9	14: 13	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	B10	14: 29	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	B1a	14: 47	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	B1c	15: 12	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	A1	15: 19	Rainy	0.0%	0	20.3	0%LEL	30.4℃	
6-Jun-26	L60	15: 35	Rainy	0.0%	0	20.3	0%LEL	30.4℃	

Landfill Gas Monitoring - Field Measurement Recording Sheet

Contract No.: EP/SP/186/21
Name of construction site: West New Territories Landfill Extension
Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	10-Dec-25
SKY3000 Series (LEL)	30-Jan-26

Date of measurement	Sample location	Sampling time	Monitoring of Excavation						
			Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (°C)	Remark
7-Jun-26	C1	8: 33	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	B2	8: 48	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	B9	8: 59	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	B10	9: 12	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	B1a	9: 29	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	B1c	9: 43	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	A1	9: 59	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	L60	10: 13	Cloudy	0.0%	0	20.4	0%LEL	28.1°C	
7-Jun-26	C1	13: 31	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	B2	13: 49	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	B9	14: 5	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	B10	14: 19	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	B1a	14: 34	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	B1c	14: 52	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	A1	15: 6	Cloudy	0.0%	0	20.4	0%LEL	32°C	
7-Jun-26	L60	15: 19	Cloudy	0.0%	0	20.4	0%LEL	32°C	
8-Jun-26	C1	8: 30	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	B2	8: 49	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	B9	9: 6	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	B10	9: 21	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	B1a	9: 39	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	B1c	9: 58	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	A1	10: 15	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	L60	10: 29	Rainy	0.0%	0	20.5	0%LEL	27.6°C	
8-Jun-26	C1	13: 29	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	B2	13: 47	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	B9	14: 6	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	B10	14: 28	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	B1a	14: 40	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	B1c	14: 59	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	A1	15: 16	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
8-Jun-26	L60	15: 29	Rainy	0.0%	0	20.5	0%LEL	30.9°C	
9-Jun-26	C1	8: 37	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	B2	8: 56	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	B9	9: 16	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	B10	9: 33	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	B1a	9: 47	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	B1c	10: 2	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	A1	10: 18	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
9-Jun-26	L60	15: 29	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	C1	13: 35	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	B2	13: 57	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	B9	14: 14	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	B10	14: 28	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	B1a	14: 47	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	B1c	15: 3	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	L60	15: 29	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
9-Jun-26	A1	15: 26	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
10-Jun-26	C1	8: 29	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	B2	8: 50	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	B9	9: 6	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	B10	9: 23	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	B1a	9: 45	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	B1c	10: 10	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	L60	15: 29	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	A1	10: 24	Sunny	0.0%	0	20.3	0%LEL	26.3°C	
10-Jun-26	C1	13: 31	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	B2	13: 48	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	B9	14: 3	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	B10	14: 21	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	B1a	14: 39	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	B1c	14: 58	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	L60	15: 29	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
10-Jun-26	A1	15: 34	Sunny	0.0%	0	20.3	0%LEL	28.6°C	
11-Jun-26	C1	8: 30	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	B2	8: 51	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	B9	9: 9	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	B10	9: 25	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	B1a	9: 42	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	B1c	9: 59	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	L60	10: 12	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	A1	10: 15	Sunny	0.0%	0	20.4	0%LEL	26.7°C	
11-Jun-26	C1	13: 36	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	B2	13: 58	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	B9	14: 10	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	B10	14: 29	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	B1a	14: 48	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	B1c	15: 10	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	L60	15: 12	Sunny	0.0%	0	20.4	0%LEL	29°C	
11-Jun-26	A1	15: 18	Sunny	0.0%	0	20.4	0%LEL	29°C	
12-Jun-26	C1	8: 37	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	B2	8: 59	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	B9	9: 15	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	B10	9: 28	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	B1a	9: 42	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	B1c	9: 59	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	A1	10: 18	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	L60	10: 33	Cloudy	0.0%	0	20.5	0%LEL	27.4°C	
12-Jun-26	C1	13: 28	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	B2	13: 47	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	B9	14: 8	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	B10	14: 30	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	B1a	14: 49	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	B1c	15: 7	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	A1	15: 25	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	
12-Jun-26	L60	15: 40	Cloudy	0.0%	0	20.5	0%LEL	30.4°C	

Landfill Gas Monitoring - Field Measurement Recording Sheet

Contract No.: EP/SP/186/21
Name of construction site: West New Territories Landfill Extension
Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	10-Dec-25
SKY3000 Series (LEL)	30-Jan-26

Date of measurement	Sample location	Sampling time	Monitoring of Excavation						
			Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (°C)	Remark
13-Jun-26	C1	8: 29	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	B2	8: 52	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	B9	9: 10	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	B10	9: 21	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	B1a	9: 44	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	B1c	10: 11	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	A1	10: 18	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	L60	10: 33	Rainy	0.0%	0	20.3	0%LEL	27.8°C	
13-Jun-26	C1	13: 37	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	B2	13: 58	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	B9	14: 12	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	B10	14: 24	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	B1a	14: 43	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	B1c	14: 59	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	A1	15: 17	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
13-Jun-26	L60	15: 31	Rainy	0.0%	0	20.3	0%LEL	30.6°C	
14-Jun-26	C1	8: 37	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	B2	8: 59	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	B9	9: 16	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	B10	9: 34	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	B1a	9: 53	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	B1c	10: 12	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	A1	10: 33	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	L60	10: 47	Rainy	0.0%	0	20.3	0%LEL	28.9°C	
14-Jun-26	C1	13: 33	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	B2	13: 52	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	B9	14: 9	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	B10	14: 25	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	B1a	14: 44	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	B1c	14: 58	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	A1	15: 16	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
14-Jun-26	L60	15: 31	Rainy	0.0%	0	20.3	0%LEL	29.5°C	
15-Jun-26	C1	8: 29	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	B2	8: 48	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	B9	9: 1	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	B10	9: 19	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	B1a	9: 43	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	B1c	9: 59	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	A1	10: 18	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	L60	10: 31	Rainy	0.0%	0	20.3	0%LEL	27.3°C	
15-Jun-26	C1	13: 31	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	B2	13: 53	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	B9	14: 11	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	B10	14: 25	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	B1a	14: 44	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	B1c	15: 1	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	A1	15: 22	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
15-Jun-26	L60	15: 36	Rainy	0.0%	0	20.3	0%LEL	29.9°C	
16-Jun-26	C1	8: 31	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	B2	8: 53	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	B9	9: 12	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	B10	9: 25	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	B1a	9: 37	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	B1c	9: 52	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	A1	10: 9	Rainy	0.0%	0	20.3	0%LEL	26.1°C	
16-Jun-26	C1	13: 29	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
16-Jun-26	B2	13: 47	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
16-Jun-26	B9	14: 2	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
16-Jun-26	B10	14: 19	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
16-Jun-26	B1a	14: 35	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
16-Jun-26	B1c	14: 54	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
16-Jun-26	A1	15: 14	Rainy	0.0%	0	20.3	0%LEL	27.1°C	
17-Jun-26	C1	8: 35	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	B2	8: 57	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	B9	9: 19	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	B10	9: 37	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	B1a	9: 58	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	B1c	10: 17	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	A1	10: 35	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	L62	10: 53	Sunny	0.0%	0	20.4	0%LEL	27°C	
17-Jun-26	C1	13: 37	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	B2	13: 58	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	B9	14: 15	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	B10	14: 36	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	B1a	14: 57	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	B1c	15: 14	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	A1	15: 32	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
17-Jun-26	L62	15: 45	Sunny	0.0%	0	20.4	0%LEL	28.4°C	
18-Jun-26	C1	8: 29	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	B2	8: 55	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	B9	9: 14	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	B10	9: 32	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	B1a	9: 51	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	B1c	10: 6	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	A1	10: 25	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	L62	10: 38	Rainy	0.0%	0	20.5	0%LEL	27.1°C	
18-Jun-26	C1	13: 33	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	B2	13: 49	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	B9	14: 3	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	B10	14: 20	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	B1a	14: 39	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	B1c	15: 0	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	A1	15: 16	Rainy	0.0%	0	20.5	0%LEL	29°C	
18-Jun-26	L62	15: 28	Rainy	0.0%	0	20.5	0%LEL	29°C	

Landfill Gas Monitoring - Field Measurement Recording Sheet

Contract No.: EP/SP/186/21
Name of construction site: West New Territories Landfill Extension
Month of measurement :

Sampling equipment used:	Date calibrated
GEM5000	10-Dec-25
SKY3000 Series (LEL)	30-Jan-26

Date of measurement	Sample location	Sampling time	Monitoring of Excavation						Remark
			Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (°C)	
19-Jun-26	C1	8: 41	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	B2	9: 7	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	B9	9: 21	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	B10	9: 38	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	B1a	9: 57	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	B1c	10: 16	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	A1	10: 35	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	L62	10: 48	Sunny	0.0%	0	20.4	0%LEL	29.3℃	
19-Jun-26	C1	13: 29	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	B2	13: 48	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	B9	14: 8	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	B10	14: 24	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	B1a	14: 43	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	B1c	15: 1	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	A1	15: 21	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
19-Jun-26	L62	15: 38	Sunny	0.0%	0	20.4	0%LEL	31.3℃	
20-Jun-26	C1	8: 41	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	B2	9: 2	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	B9	9: 20	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	B10	9: 38	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	B1a	9: 57	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	B1c	10: 14	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	A1	10: 30	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	L62	10: 43	Sunny	0.0%	0	20.2	0%LEL	29.6℃	
20-Jun-26	C1	13: 38	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	B2	13: 59	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	B9	14: 17	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	B10	14: 31	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	B1a	14: 48	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	B1c	15: 5	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	A1	15: 21	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
20-Jun-26	L62	15: 37	Sunny	0.0%	0	20.2	0%LEL	31.5℃	
21-Jun-26	C1	8: 35	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	B2	8: 54	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	B9	9: 14	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	B10	9: 36	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	B1a	9: 52	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	B1c	10: 17	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	A1	10: 32	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	L62	10: 46	Sunny	0.0%	0	20.2	0%LEL	29.9℃	
21-Jun-26	C1	13: 31	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	B2	13: 52	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	B9	14: 4	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	B10	14: 23	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	B1a	14: 41	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	B1c	15: 0	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	A1	15: 22	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
21-Jun-26	L62	15: 35	Sunny	0.0%	0	20.2	0%LEL	33.1℃	
22-Jun-26	C1	8: 31	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	B2	8: 52	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	B9	9: 15	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	B10	9: 32	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	B1a	9: 49	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	B1c	10: 5	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	A1	10: 24	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	L62	10: 38	Sunny	0.0%	0	20.3	0%LEL	30.2℃	
22-Jun-26	C1	13: 29	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	B2	13: 48	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	B9	14: 4	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	B10	14: 25	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	B1a	14: 44	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	B1c	15: 1	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	A1	15: 22	Sunny	0.0%	0	20.3	0%LEL	33℃	
22-Jun-26	L62	15: 40	Sunny	0.0%	0	20.3	0%LEL	33℃	
23-Jun-26	C1	8: 35	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	B2	8: 55	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	B9	9: 17	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	B10	9: 32	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	B1a	9: 50	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	B1c	10: 4	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	A1	10: 25	Sunny	0.0%	0	20.2	0%LEL	30.4℃	
23-Jun-26	L62	15: 40	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	C1	13: 31	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	B2	13: 49	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	B9	14: 10	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	B10	14: 26	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	B1a	14: 48	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	B1c	15: 3	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	A1	15: 21	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
23-Jun-26	L62	15: 40	Sunny	0.0%	0	20.2	0%LEL	32.2℃	
24-Jun-26	C1	8: 34	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	B2	8: 57	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	B9	9: 15	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	B10	9: 31	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	B1a	9: 52	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	B1c	10: 9	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	A1	10: 29	Sunny	0.0%	0	20.3	0%LEL	30.7℃	
24-Jun-26	L62	15: 40	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	C1	13: 28	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	B2	13: 56	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	B9	14: 13	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	B10	14: 30	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	B1a	14: 49	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	B1c	15: 5	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	L62	15: 19	Sunny	0.0%	0	20.3	0%LEL	32.8℃	
24-Jun-26	A1	15: 40	Sunny	0.0%	0	20.3	0%LEL	32.8℃	

Landfill Gas Monitoring - Field Measurement Recording Sheet

Contract No.: EP/SP/186/21
Name of construction site: West New Territories Landfill Extension
Month of measurement :



Sampling equipment used:	Date calibrated
GEM5000	10-Dec-25
SKY3000 Series (LEL)	30-Jan-26



Date of measurement	Sample location	Sampling time	Monitoring of Excavation						
			Weather condition	Methane (CH ₄)	Carbon dioxide (0.1%)	Oxygen (0.1%)	Flammable gas (LEL)	Temp (°C)	Remark
25-Jun-26	C1	8: 40	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	B2	8: 59	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	B9	9: 15	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	B10	9: 29	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	B1a	9: 45	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	B1c	10: 10	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	A1	10: 26	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	L62	10: 49	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
25-Jun-26	C1	13: 29	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	B2	13: 50	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	B9	14: 10	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	B10	14: 26	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	B1a	14: 44	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	B1c	15: 12	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	A1	15: 25	Cloudy	0.0%	0	20.2	0%LEL	32.9℃	
25-Jun-26	L62	10: 49	Cloudy	0.0%	0	20.2	0%LEL	30.8℃	
26-Jun-26	C1	8: 33	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	B2	8: 58	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	B9	9: 15	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	B10	9: 38	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	B1a	9: 58	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	B1c	10: 14	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	A1	10: 36	Cloudy	0.0%	0	20.5	0%LEL	28.5℃	
26-Jun-26	C1	13: 31	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
26-Jun-26	B2	13: 49	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
26-Jun-26	B9	14 : 12	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
26-Jun-26	B10	14: 14	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
26-Jun-26	B1a	14: 34	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
26-Jun-26	B1c	15: 12	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
26-Jun-26	A1	15: 24	Cloudy	0.0%	0	20.5	0%LEL	31.6℃	
27-Jun-26	C1	8: 33	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	B2	9: 10	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	B9	9: 17	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	B10	9: 30	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	B1a	9 : 45	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	B1c	10: 10	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	A1	10: 28	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	L61	10: 41	Cloudy	0.0%	0	20.5	0%LEL	28.9℃	
27-Jun-26	C1	13: 31	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	B2	13 : 52	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	B9	14: 11	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	B10	14: 29	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	B1a	14 : 48	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	B1c	15: 10	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	A1	15: 21	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
27-Jun-26	L61	15: 35	Cloudy	0.0%	0	20.5	0%LEL	30.2℃	
28-Jun-26	C1	8: 32	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	B2	8: 55	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	B9	9: 21	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	B10	9: 38	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	B1a	9 : 55	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	B1c	10: 24	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	A1	10: 39	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	L61	10: 52	Cloudy	0.0%	0	20.4	0%LEL	27.9℃	
28-Jun-26	C1	13: 33	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	B2	13: 52	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	B9	14: 14	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	B10	14: 35	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	B1a	14: 59	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	B1c	15: 19	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	A1	15: 38	Cloudy	0.0%	0	20.4	0%LEL	30℃	
28-Jun-26	L61	15: 50	Cloudy	0.0%	0	20.4	0%LEL	30℃	
29-Jun-26	C1	8: 32	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	B2	8: 57	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	B9	9: 19	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	B10	9: 35	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	B1a	9: 54	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	B1c	10: 18	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	A1	10: 36	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	L61	10: 49	Cloudy	0.0%	0	20.4	0%LEL	28.7℃	
29-Jun-26	C1	13: 34	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	B2	14: 10	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	B9	14: 23	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	B10	14: 42	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	B1a	14: 59	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	B1c	15: 17	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	A1	15 : 35	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
29-Jun-26	L61	15 : 51	Cloudy	0.0%	0	20.4	0%LEL	31.6℃	
30-Jun-26	C1	8: 31	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	B2	8: 55	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	B9	9: 14	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	B10	9: 30	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	B1a	9: 58	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	B1c	10: 19	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	L61	10: 51	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	A1	10: 35	Cloudy	0.0%	0	20.5	0%LEL	28.7℃	
30-Jun-26	C1	13: 31	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	B2	13: 57	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	B9	14: 20	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	B10	14: 34	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	B1a	14: 55	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	B1c	15: 17	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	L61	15 : 36	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	
30-Jun-26	A1	15: 51	Cloudy	0.0%	0	20.5	0%LEL	32.1℃	



Appendix J

Graphical Plots for Monitoring Result



Air Quality – 1-hour TSP

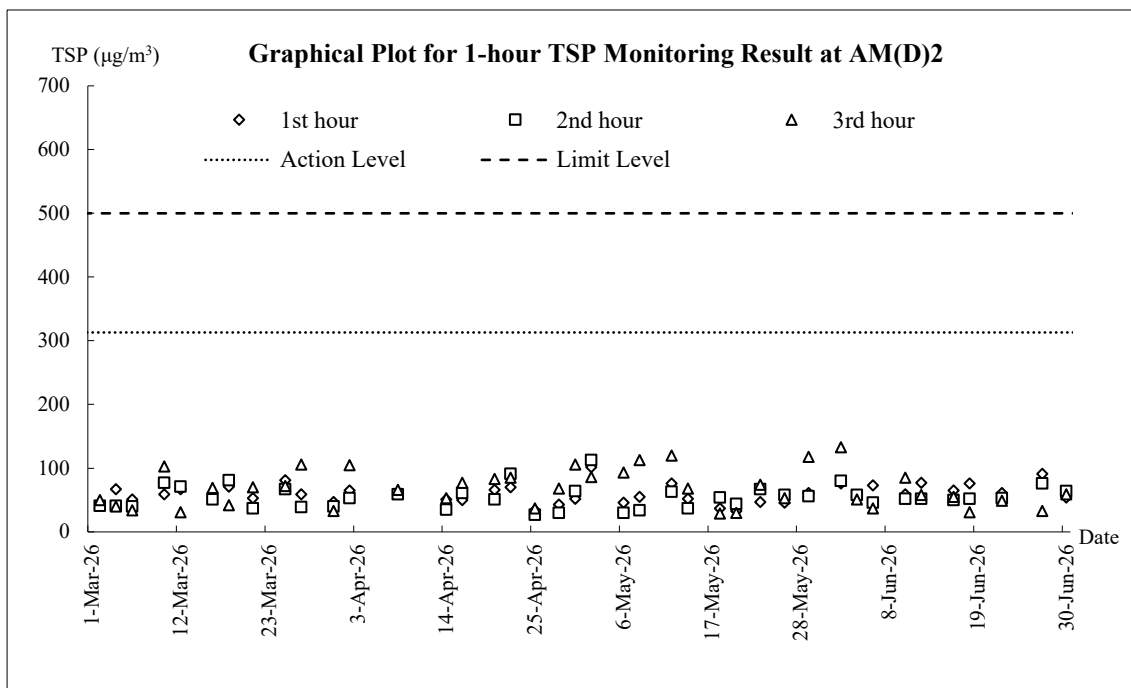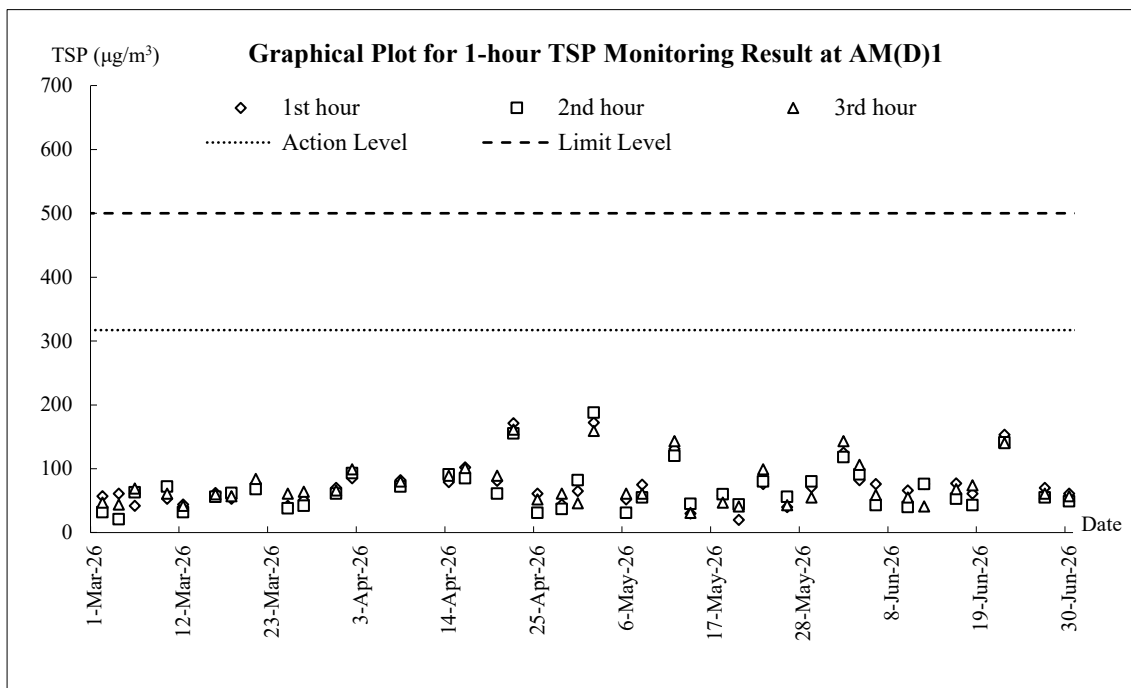

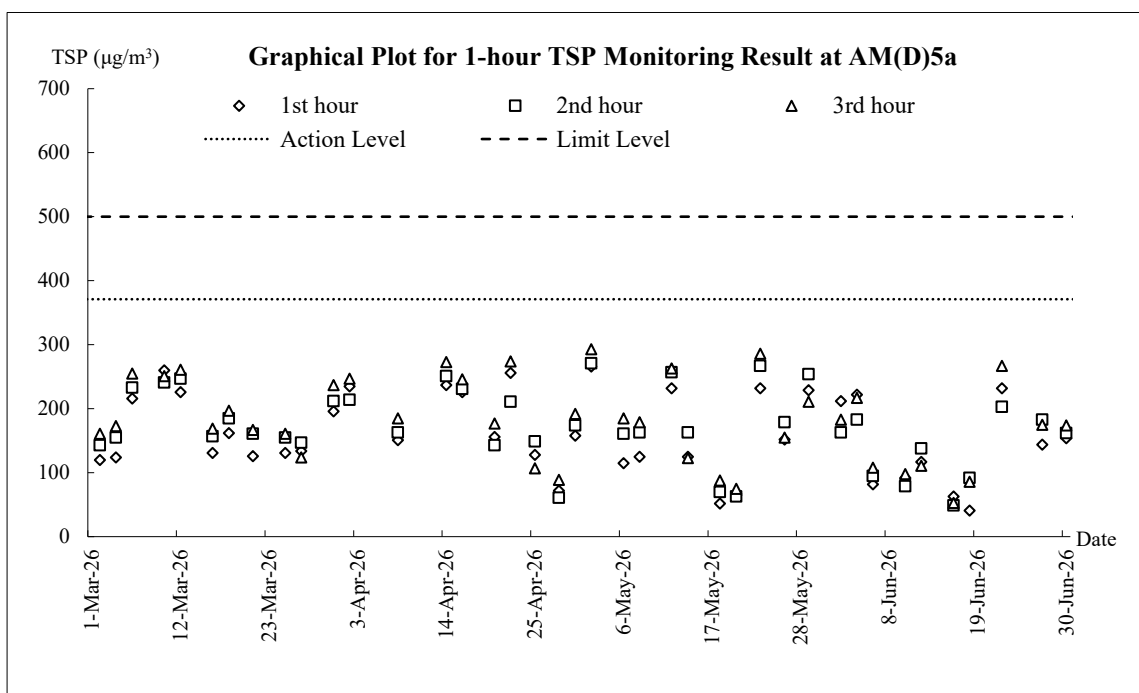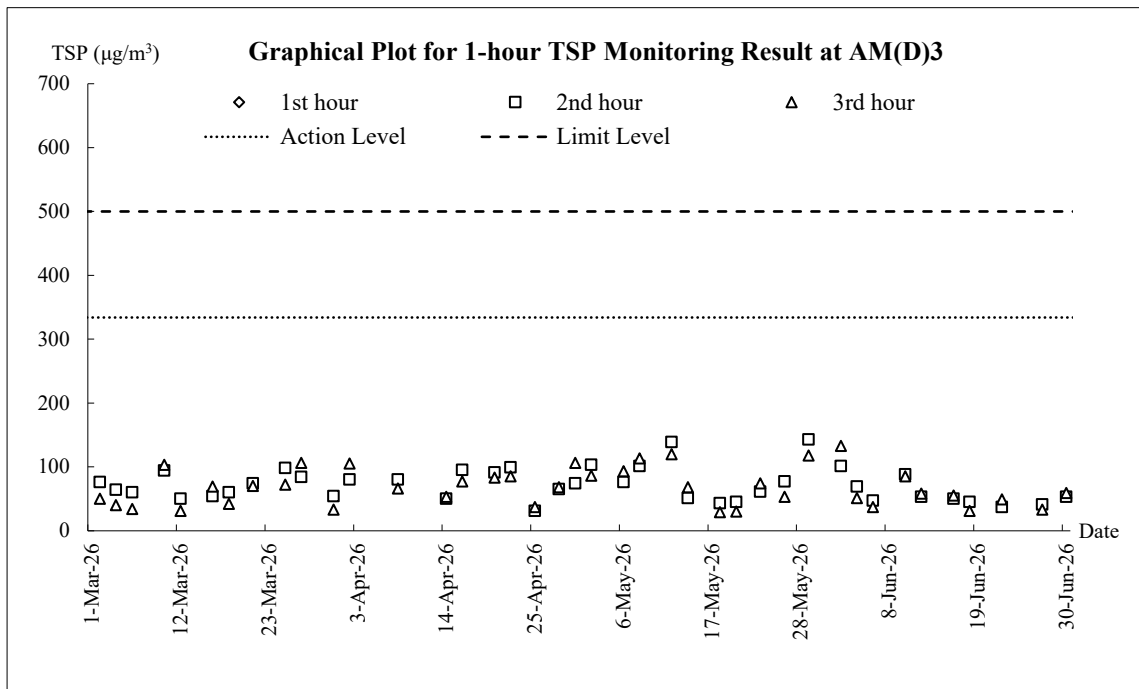


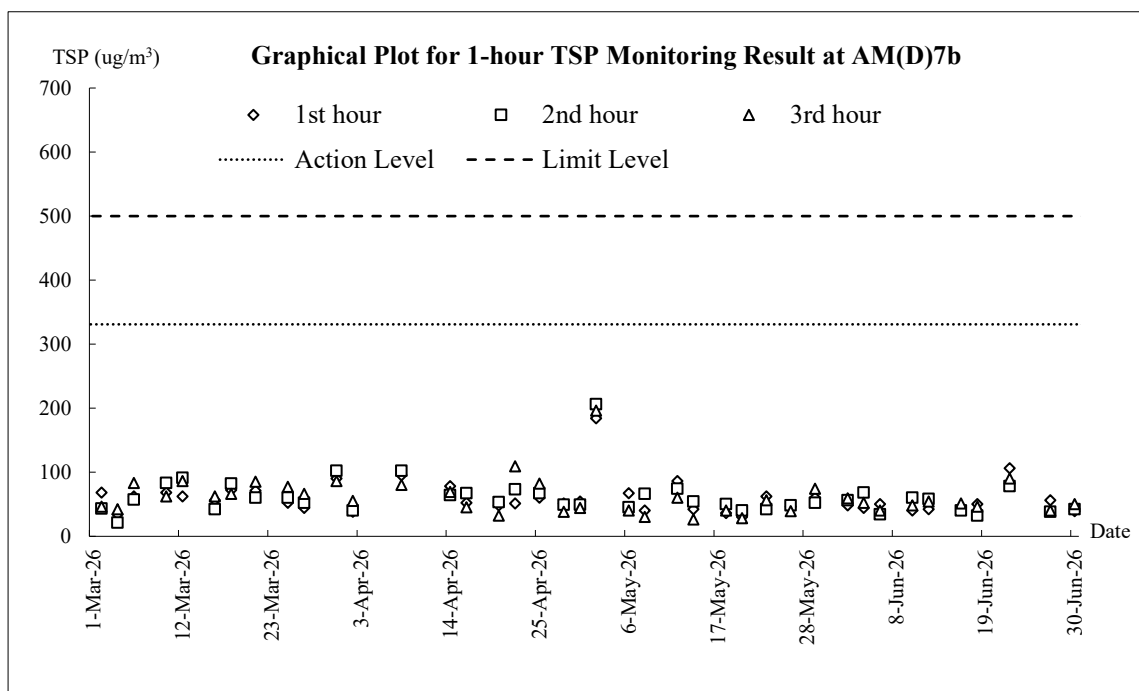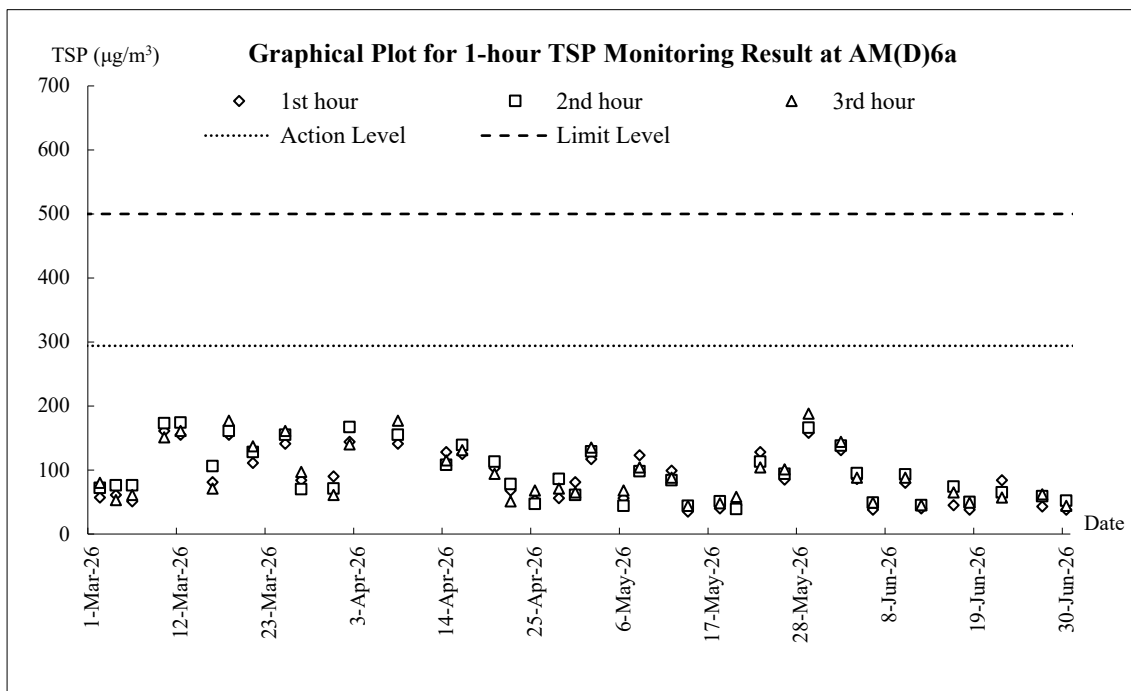


Air Quality – 24-hour TSP

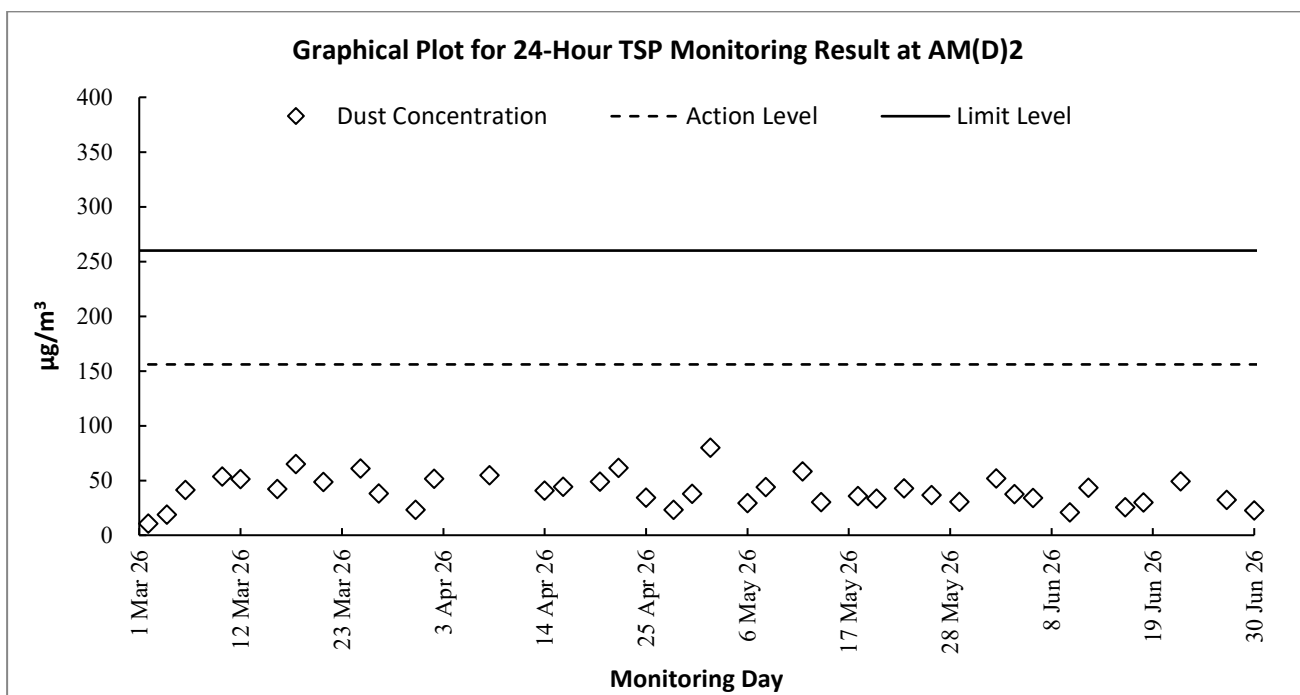
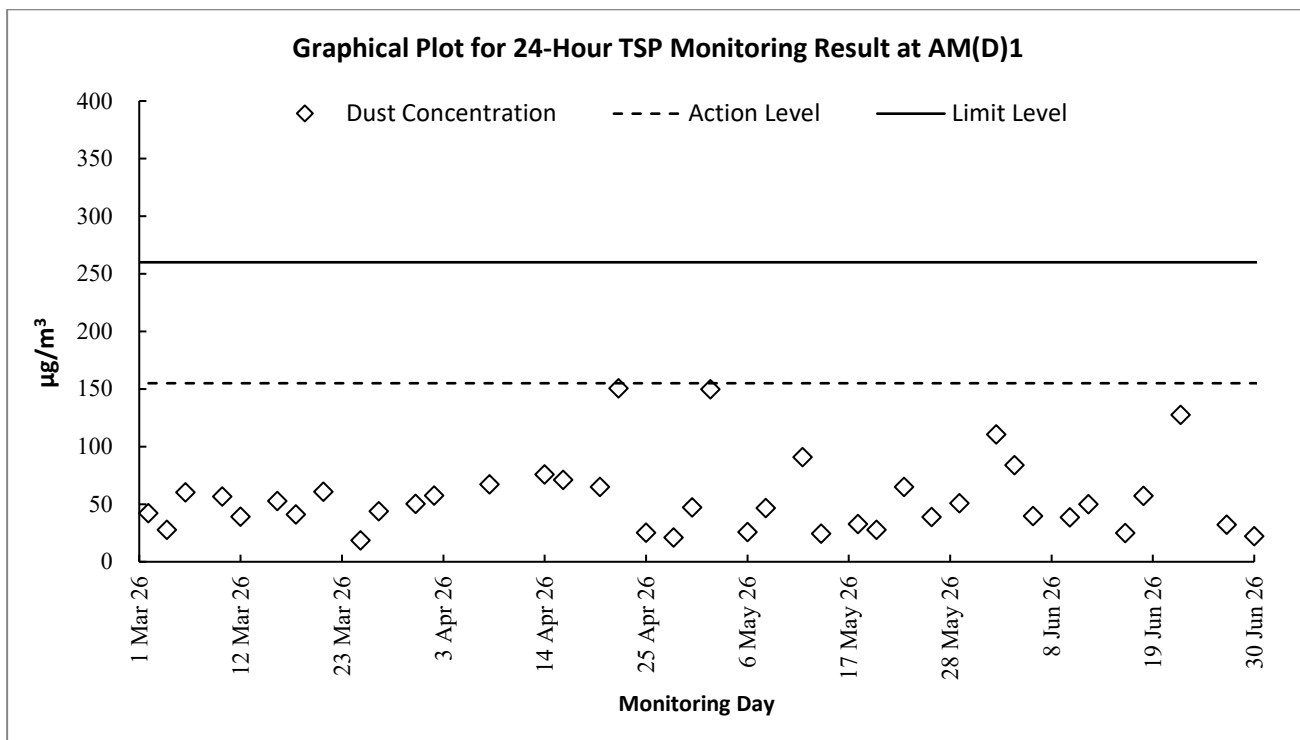


Graphical Plot for 24-Hour TSP Monitoring Result at AM(D)3

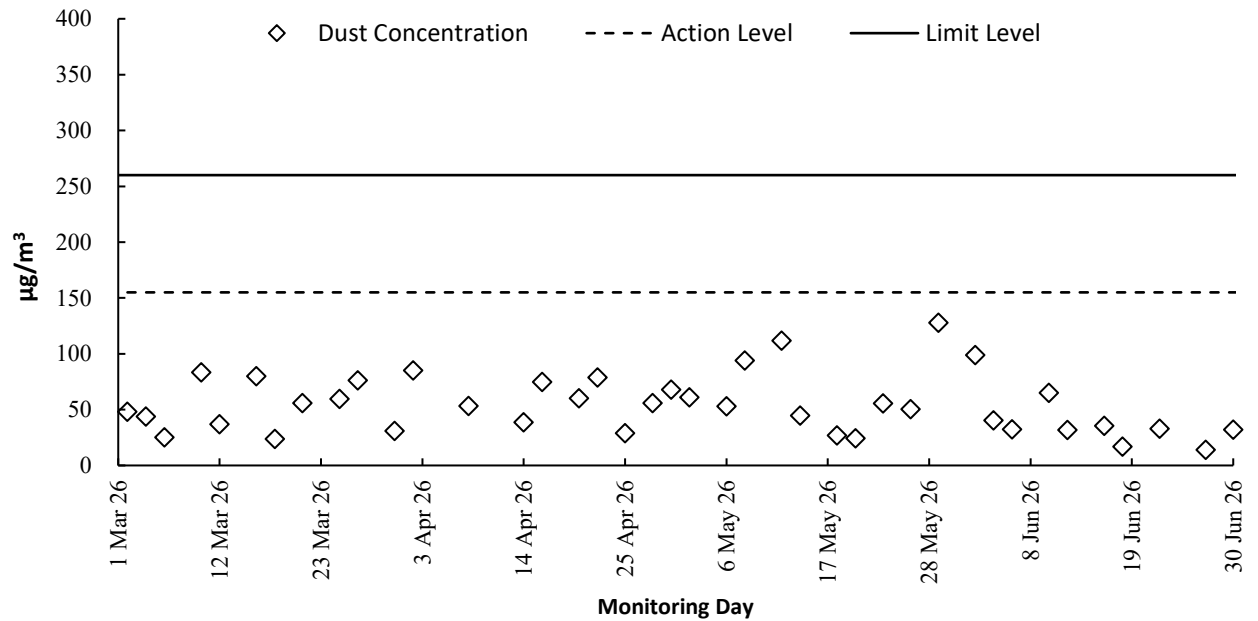


Graphical Plot for 24-Hour TSP Monitoring Result at AM(D)5a

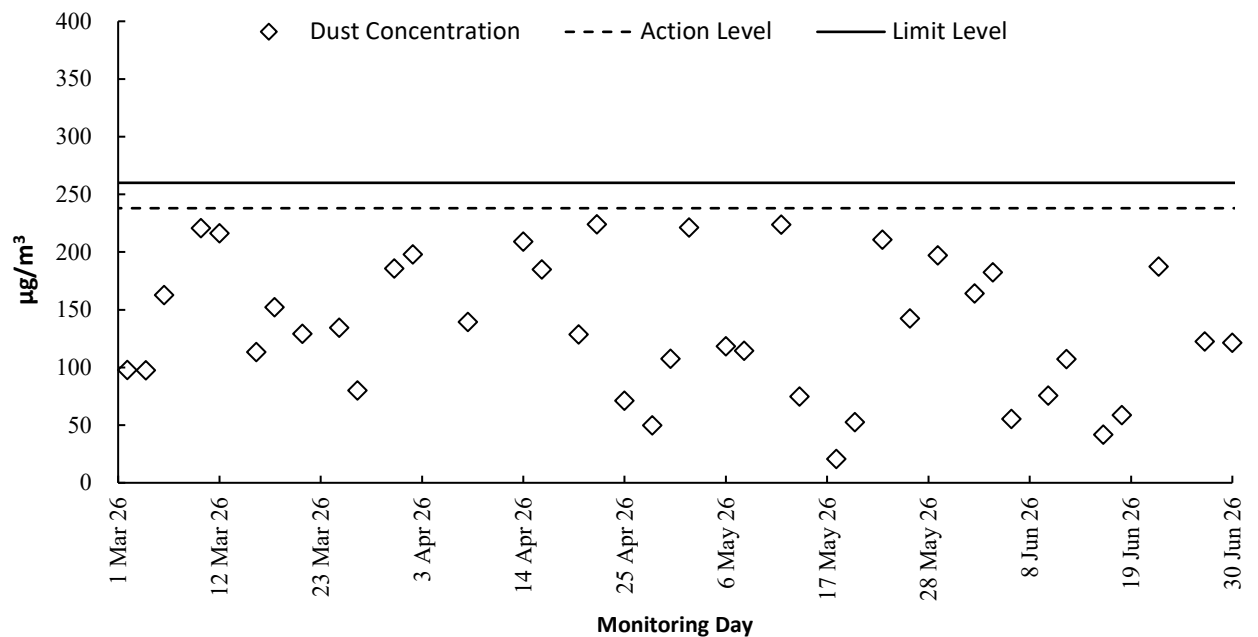


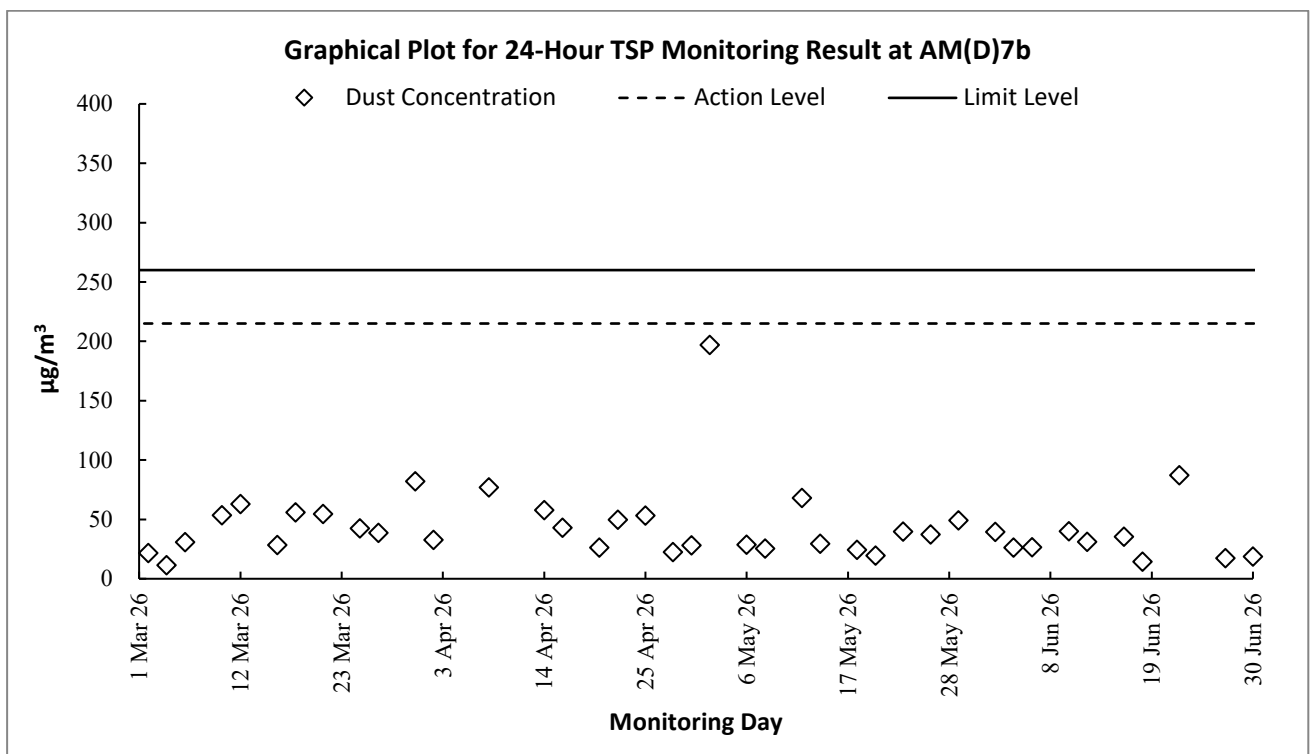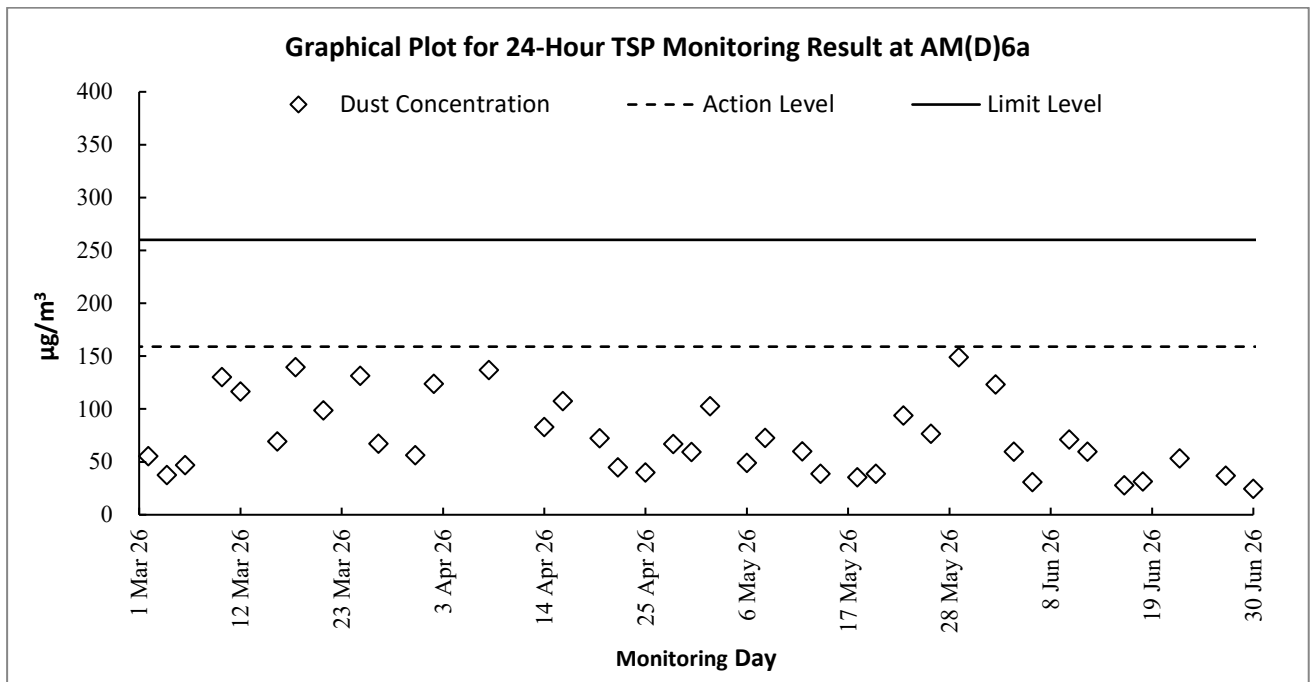



Construction Noise

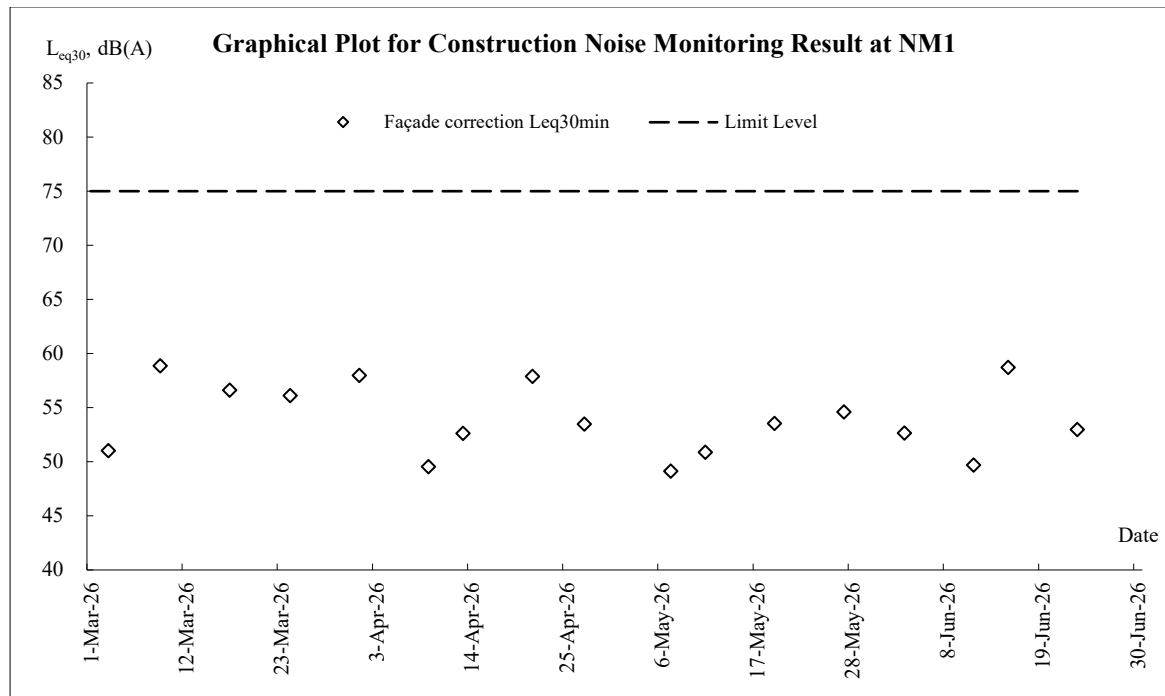

DO (mg/L)		DOS (%)																													
DO (mg/L) chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 2,000 to 11,000. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (mg/L)</th> <th>16A08d (mg/L)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>8,200</td><td>7,200</td></tr> <tr><td>14-Apr-26</td><td>7,500</td><td>6,800</td></tr> <tr><td>28-May-26</td><td>9,500</td><td>6,500</td></tr> </tbody> </table>	Date	16A08b (mg/L)	16A08d (mg/L)	1-Mar-26	8,200	7,200	14-Apr-26	7,500	6,800	28-May-26	9,500	6,500	DOS (%) chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0 to 160. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (%)</th> <th>16A08d (%)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>110</td><td>95</td></tr> <tr><td>14-Apr-26</td><td>105</td><td>95</td></tr> <tr><td>28-May-26</td><td>145</td><td>95</td></tr> </tbody> </table>	Date	16A08b (%)	16A08d (%)	1-Mar-26	110	95	14-Apr-26	105	95	28-May-26	145	95						
Date	16A08b (mg/L)	16A08d (mg/L)																													
1-Mar-26	8,200	7,200																													
14-Apr-26	7,500	6,800																													
28-May-26	9,500	6,500																													
Date	16A08b (%)	16A08d (%)																													
1-Mar-26	110	95																													
14-Apr-26	105	95																													
28-May-26	145	95																													
Turbidity (NTU) chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0.00 to 40.00. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (NTU)</th> <th>16A08d (NTU)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>6.0</td><td>14.0</td></tr> <tr><td>14-Apr-26</td><td>12.0</td><td>10.0</td></tr> <tr><td>28-May-26</td><td>19.0</td><td>4.5</td></tr> <tr><td>8-Jun-26</td><td>10.0</td><td>10.0</td></tr> </tbody> </table>	Date	16A08b (NTU)	16A08d (NTU)	1-Mar-26	6.0	14.0	14-Apr-26	12.0	10.0	28-May-26	19.0	4.5	8-Jun-26	10.0	10.0	Salinity (ppt) chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0.00 to 40.00. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (ppt)</th> <th>16A08d (ppt)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>28.0</td><td>28.0</td></tr> <tr><td>14-Apr-26</td><td>19.0</td><td>20.0</td></tr> <tr><td>28-May-26</td><td>15.0</td><td>18.0</td></tr> </tbody> </table>	Date	16A08b (ppt)	16A08d (ppt)	1-Mar-26	28.0	28.0	14-Apr-26	19.0	20.0	28-May-26	15.0	18.0			
Date	16A08b (NTU)	16A08d (NTU)																													
1-Mar-26	6.0	14.0																													
14-Apr-26	12.0	10.0																													
28-May-26	19.0	4.5																													
8-Jun-26	10.0	10.0																													
Date	16A08b (ppt)	16A08d (ppt)																													
1-Mar-26	28.0	28.0																													
14-Apr-26	19.0	20.0																													
28-May-26	15.0	18.0																													
pH value - In-situ Measurement chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0.00 to 10.00. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (pH)</th> <th>16A08d (pH)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>8.0</td><td>8.0</td></tr> <tr><td>14-Apr-26</td><td>7.8</td><td>7.8</td></tr> <tr><td>28-May-26</td><td>8.2</td><td>7.8</td></tr> </tbody> </table>	Date	16A08b (pH)	16A08d (pH)	1-Mar-26	8.0	8.0	14-Apr-26	7.8	7.8	28-May-26	8.2	7.8	Conductivity (µS/cm) - In-situ Measurement chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0.0 to 60,000.0. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (µS/cm)</th> <th>16A08d (µS/cm)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>40,000</td><td>40,000</td></tr> <tr><td>14-Apr-26</td><td>31,000</td><td>33,000</td></tr> <tr><td>28-May-26</td><td>28,000</td><td>31,000</td></tr> </tbody> </table>	Date	16A08b (µS/cm)	16A08d (µS/cm)	1-Mar-26	40,000	40,000	14-Apr-26	31,000	33,000	28-May-26	28,000	31,000						
Date	16A08b (pH)	16A08d (pH)																													
1-Mar-26	8.0	8.0																													
14-Apr-26	7.8	7.8																													
28-May-26	8.2	7.8																													
Date	16A08b (µS/cm)	16A08d (µS/cm)																													
1-Mar-26	40,000	40,000																													
14-Apr-26	31,000	33,000																													
28-May-26	28,000	31,000																													
Suspended Solids (mg/L) chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0.0 to 60.0. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (mg/L)</th> <th>16A08d (mg/L)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>7.0</td><td>19.0</td></tr> <tr><td>14-Apr-26</td><td>18.0</td><td>18.0</td></tr> <tr><td>28-May-26</td><td>21.0</td><td>7.0</td></tr> <tr><td>8-Jun-26</td><td>11.0</td><td>9.0</td></tr> </tbody> </table>	Date	16A08b (mg/L)	16A08d (mg/L)	1-Mar-26	7.0	19.0	14-Apr-26	18.0	18.0	28-May-26	21.0	7.0	8-Jun-26	11.0	9.0	Total Alkalinity (mg/L) chart showing data for 16A08b (blue diamonds) and 16A08d (red triangles) against Action Level (solid blue line) and Limit Level (dashed blue line). The Y-axis ranges from 0.0 to 120.0. The X-axis shows dates from 1-Mar-26 to 30-Jun-26. <table border="1"> <thead> <tr> <th>Date</th> <th>16A08b (mg/L)</th> <th>16A08d (mg/L)</th> </tr> </thead> <tbody> <tr><td>1-Mar-26</td><td>95</td><td>105</td></tr> <tr><td>14-Apr-26</td><td>105</td><td>105</td></tr> <tr><td>28-May-26</td><td>75</td><td>105</td></tr> <tr><td>8-Jun-26</td><td>88</td><td>105</td></tr> </tbody> </table>	Date	16A08b (mg/L)	16A08d (mg/L)	1-Mar-26	95	105	14-Apr-26	105	105	28-May-26	75	105	8-Jun-26	88	105
Date	16A08b (mg/L)	16A08d (mg/L)																													
1-Mar-26	7.0	19.0																													
14-Apr-26	18.0	18.0																													
28-May-26	21.0	7.0																													
8-Jun-26	11.0	9.0																													
Date	16A08b (mg/L)	16A08d (mg/L)																													
1-Mar-26	95	105																													
14-Apr-26	105	105																													
28-May-26	75	105																													
8-Jun-26	88	105																													

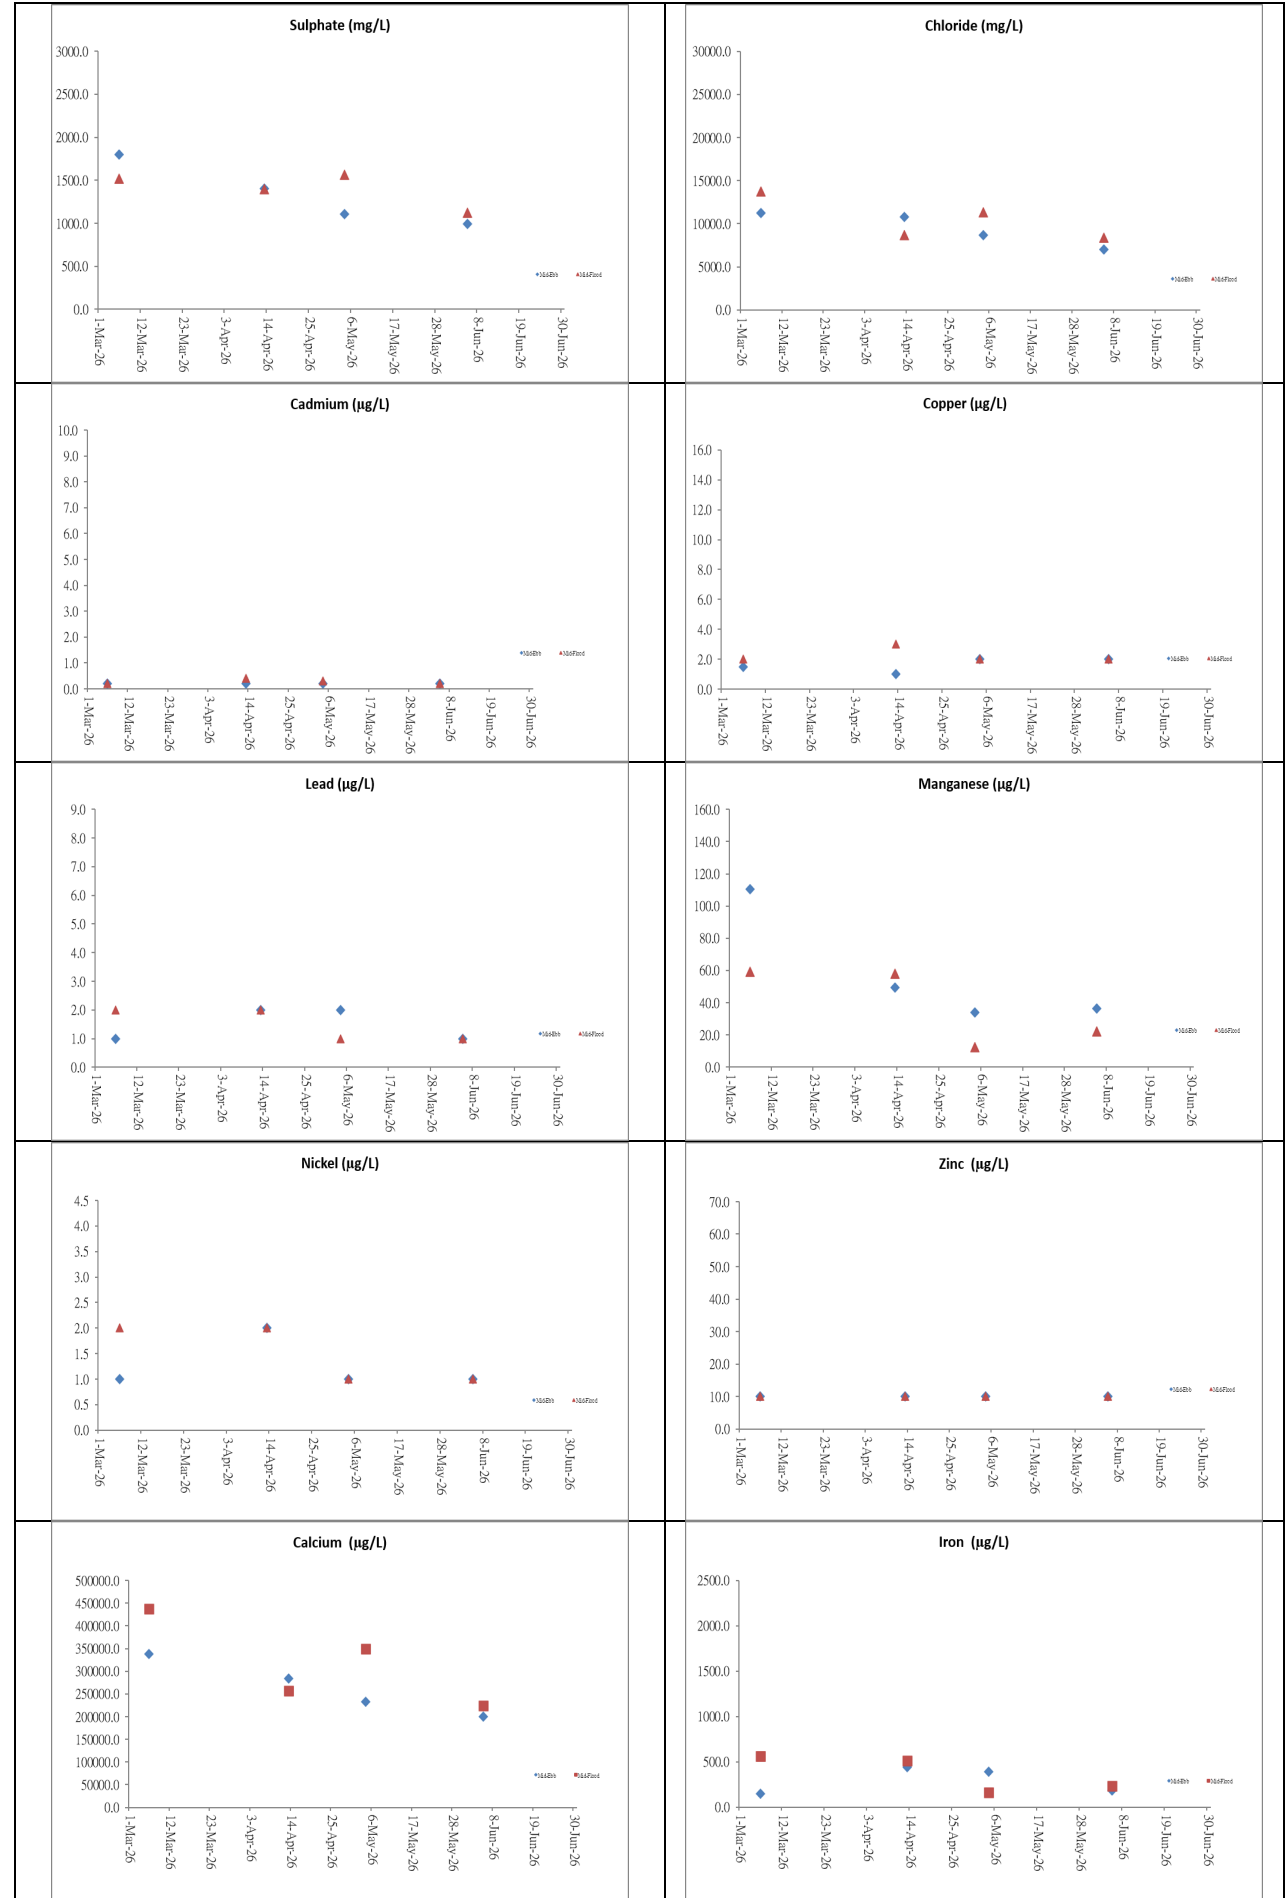

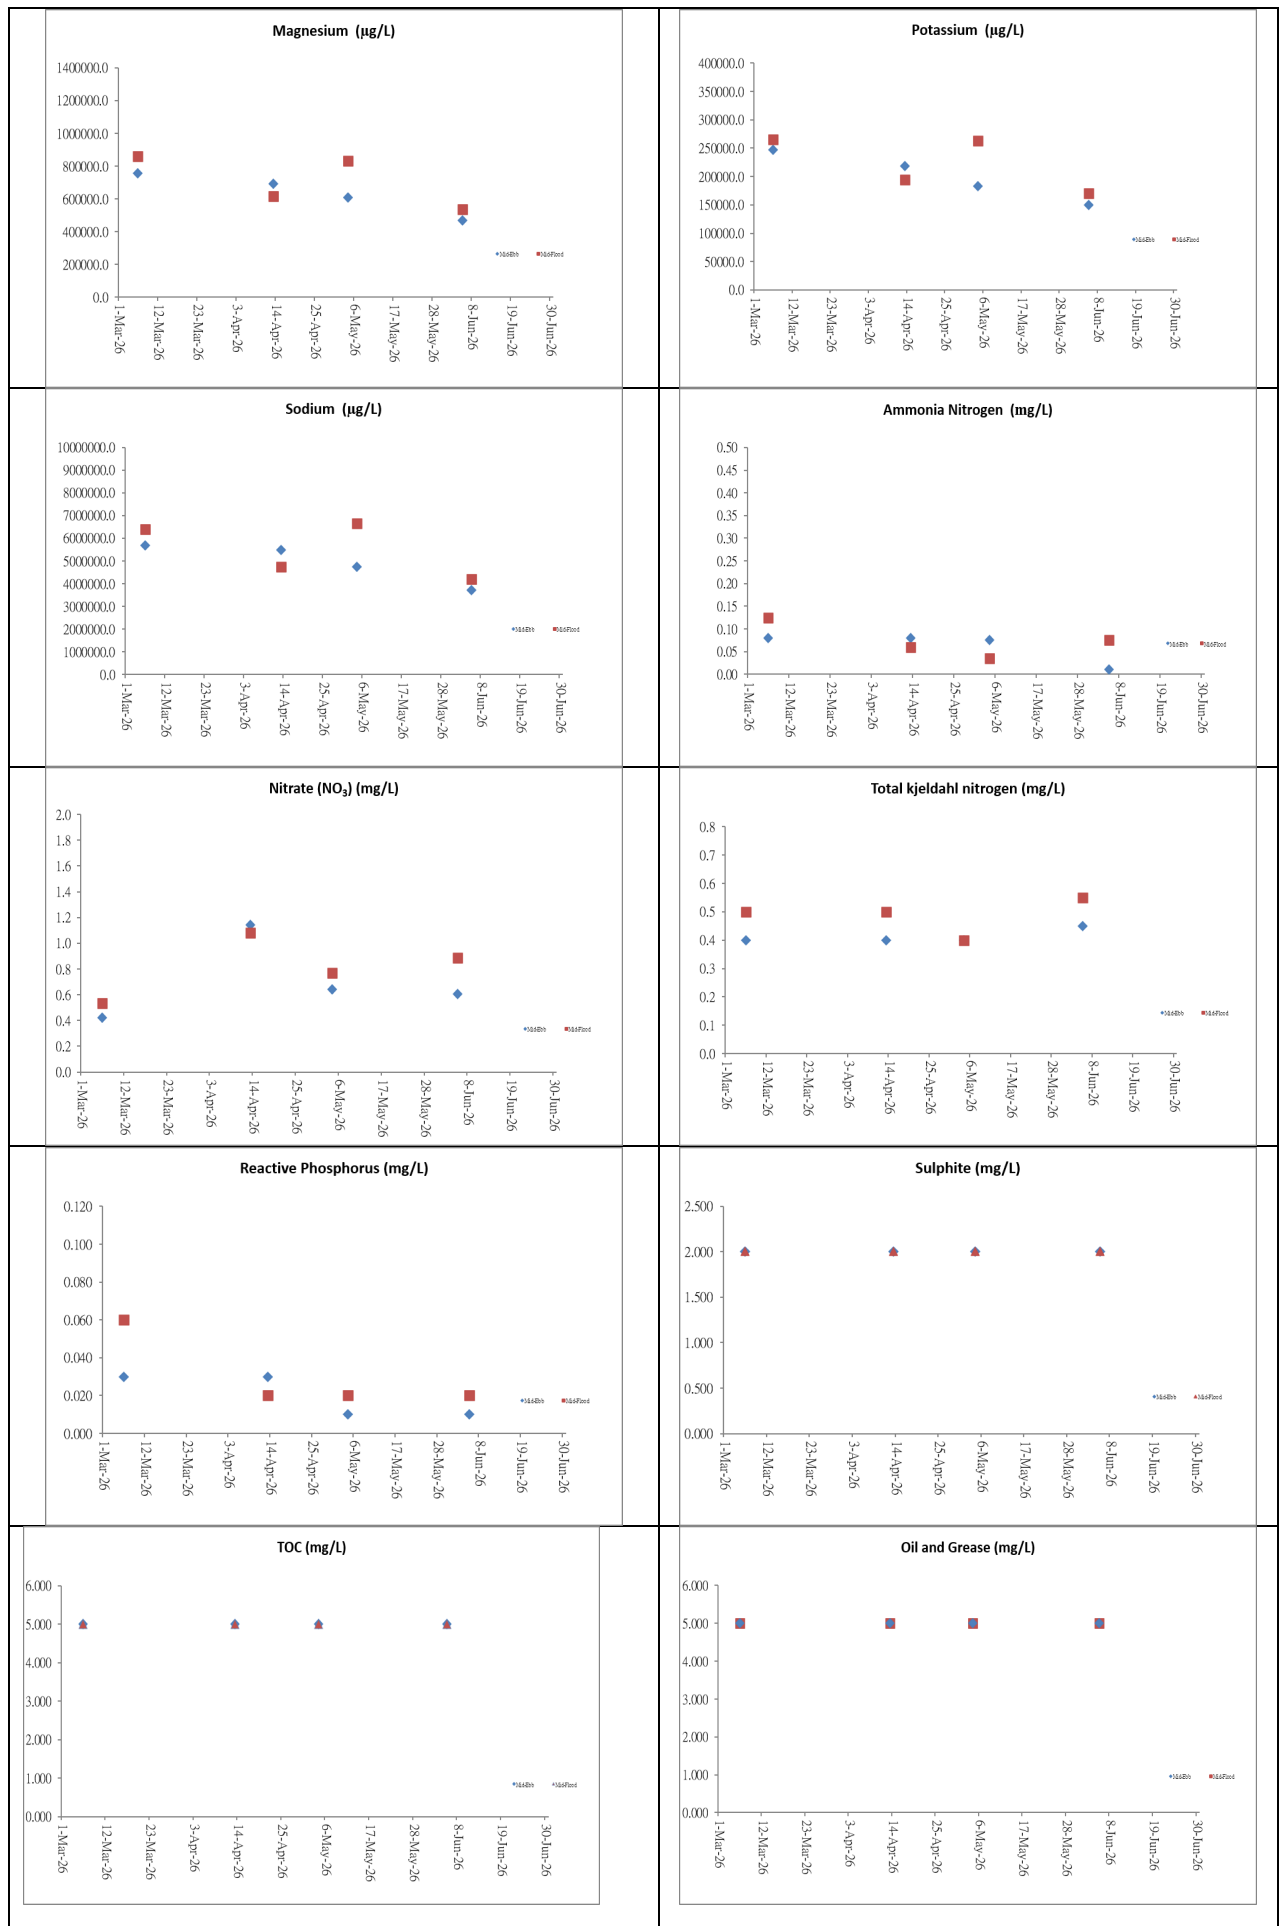

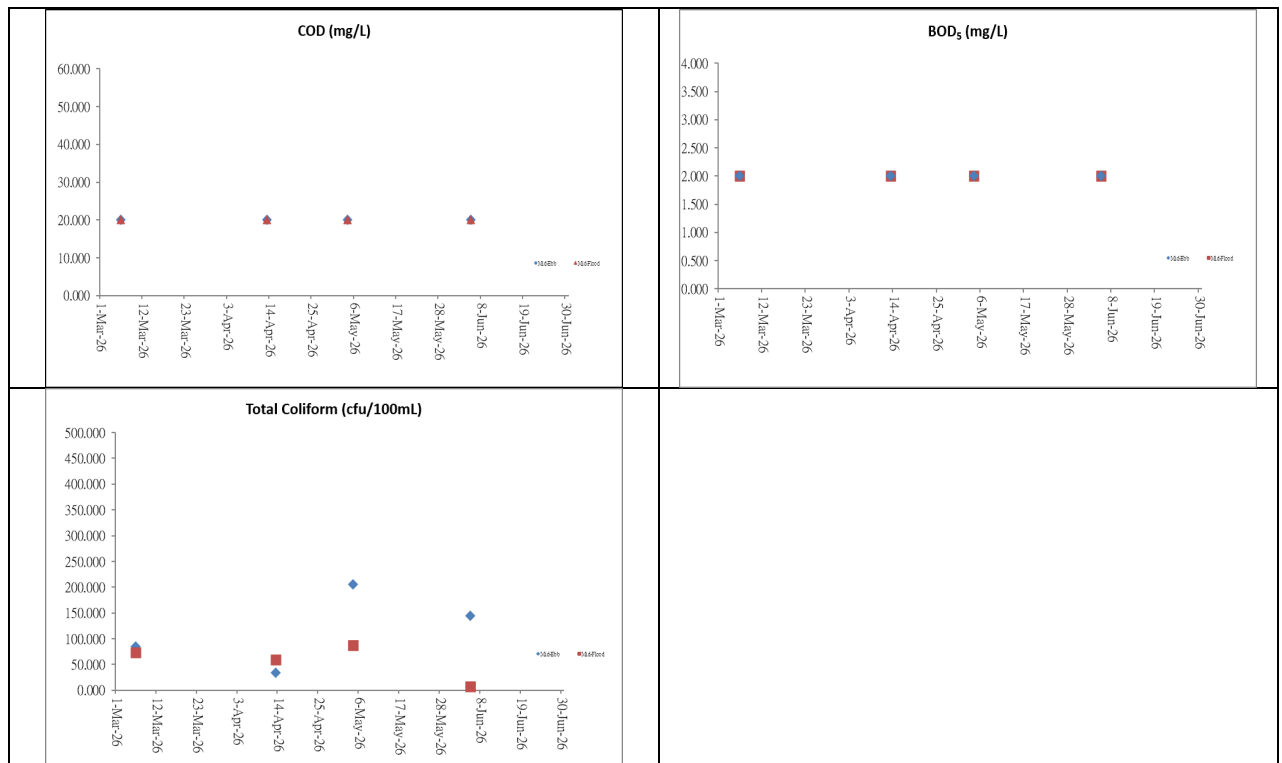

Appendix K

Waste Flow Table

Monthly Summary Waste Flow Table

(Specification Part A Clause 1.16.5.4 refers)

Name of Department: EPD

Contract No.: EP/SP/186/21 West New Territories Landfill Extension

Monthly Summary Waste Flow Table for 2026.(year)

Month 2023 to 2025	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of C&D Waste Generated Monthly						
	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics	Chemical Waste		Yard Waste	Others, e.g. general refuse
	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in '000m3)	(in kg)	(in kg)	(in kg)	(in liter)	(in '000kg)	(in tonne)	(in '000m3)
	1062.488	0.000	642.413	418.243	1.831	216.576	132052.400	134.500	33.200	60520.000	1.200	7241.470	13.468
Jan	18.112	0.000	18.052	0.060	0.000	0.000	2.100	22.900	5.700	0.000	0.000	0.000	0.236
Feb	11.667	0.000	11.654	0.013	0.000	0.000	0.000	5.100	1.000	16659.000	0.000	0.000	0.196
Mar	18.688	0.000	18.688	0.000	0.000	0.000	2.200	6.200	2.400	0.000	0.000	2.450	0.338
Apr	14.295	0.000	14.295	0.000	0.000	0.000	2.200	20.100	2.600	2000.000	0.000	4.970	0.323
May	13.282	0.000	13.282	0.000	0.000	0.234	0.900	1.800	1.900	0.000	0.000	0.000	0.323
Jun	11.463	0.000	11.463	0.000	0.000	0.000	4.700	6.200	7.600	1600.000	0.000	0.000	0.365
Sub-Total	1149.995	0.000	729.847	418.316	1.831	216.810	132064.500	196.800	54.400	80779.000	1.200	7248.890	15.249
Jul													
Aug													
Sep													
Oct													
Nov													
Dec													
Total	1149.995	0.000	729.847	418.316	1.831	216.810	132064.500	196.800	54.400	80779.000	1.200	7248.890	15.249

Note:

- (1) Plastics refer to plastic bottles/containers, plastic sheets/foam from packaging materials
- (2) Project Commenced in Sep 2023.
- (3) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
- (4) The Contractor shall also submit the latest forecast of the total amount of C&D materials expected to be generated from the Works, together with a breakdown of the nature where the total amount of C&D materials expected to be generated from the Works is equal to or exceeding 50,000 m³.
- (5) Density values and Bulk Factors adopted:

Hard Rock (reuse in the contract) and Large Broken Concrete:	2.5 T/m ³ (in-situ)	Imported Rock:	2.0 T/m ³
Soil/Fill:	2.0 T/m ³ (in-situ)	Imported Soil / Import Public Fill:	1.8 T/m ³
General Refuse:	900 Kg/m ³	Imported Sand:	1.6 T/m ³

- (6) Yard Waste is sent to Y Park as recyclable.

Appendix L

Cumulative Environmental Complaints Log

Environmental Complaint Log ref.	Date of Complaint Received	Date of Received by ET	Complaint nature	Channel	Investigation Summary & Conclusion	Status
WENTX – 01	25 June 2025	26 June 2025	Air Quality	Project's PR Team	The HKRRP's PR team received a complaint from the Ha Pak Nai Village Head on 25 June 2025 regarding the dust problem generated from the construction site of WENTX. A video provided by the Village Head indicated that inadequate dust suppression measures were being implemented at Portion A1. As confirmed by HKRRP, the major construction activities carried out at Portion A1 on 25 June 2025 included soft and hard excavation and blasting. Upon receipt of the complaint, an ad-hoc site inspection on Portion A1 was conducted by the ET on the morning of 30 June 2025 to evaluate the implementation of dust mitigation measures and assess the effectiveness. According to the impact air quality monitoring result on 25 June 2025 (the day of the complaint) and 28 June 2025 (additional monitoring, no exceedances of environmental performance criteria were recorded for 1-hr TSP and 24-hr TSP. This indicates that the air quality for nearby sensitive receivers were within acceptable levels. In our investigation, HKRRP implemented dust mitigation measures to reduce to potential impact to nearby ASRs, and no exceedances recorded during the concerned day. It is considered that the complaint was a one-off incident with short-term impact. HKRRP was reminded to implement the recommended Environmental Mitigation Implementation Schedule, specifically to carry out watering 8 times per day during construction phase and to implement the mitigation measures as far as practicable, as recommended in the EM&A Program.	Completed

WENTX – 02	28 August 2025	29 August 2025	Air Quality & Noise	EPD Project Team	A complaint letter was received by EPD on 28 August 2025, regarding the noise and dust impact generated near the entrance of the Hung-Shing Temple from the construction activities. As advised by HKRRP, the concerned site is located within Portion C1a and this portion of land was handed over to the HKRRP on 25 September 2024 and Hung-Shing Temple (洪聖公廟) is located adjacent to the Portion C1a boundary. Site clearance and formation of a temporary accessed road from Portion C1 to Portion F at Portion C1a was commenced in July 2025 and substantially completed on 4 August 2025. During the construction activities were being carried out at Portion C1a, mitigation measures of noise and dust were properly in place and maintained throughout the work period. Moreover, the temporary access road from Portion C1 to Portion F is idle, and no significant work was observed within approximately 100 meters from the entrance of the temple. According to the impact monitoring result in July and August 2025, no exceedances of environmental performance criteria were recorded. This indicates that the air quality and construction noise impact to the nearby sensitive receivers were within acceptable levels. In conclusion, all site activities are strictly confined within the designated site boundary, and environmental mitigation measures have been properly implemented and monitored, no adverse environmental impact near the entrance of the Hung-Shing Temple arising from the site works is anticipated. As the temporary access road is currently idle after completion of work in early August, it is considered that the complaint is unlikely valid to the works under the Project.	Completed
------------	----------------	----------------	---------------------	------------------	--	-----------

WENTX – 03	10 September 2025	15 September 2025	Water Quality	EPD	A complaint was received by EPD on 10 September 2025, regarding the flooded access road observed in Portion C1. As advised by the Contractor, the flooded access road in Portion C1 was due to heavy rainfall encountered on 8 September 2025 when Tropical Cyclone Warning Signal No. 3 and No. 8 was in force. Upon observed the accumulation of surface runoff, mitigation measures such as additional submersible pumps and vacuum truck were provided by the Contractor to remove the accumulated surface runoff. Since the access road is within the site area, no untreated surface runoff was discharged out of site boundary. It is considered that the flooded access road caused by heavy rainfall was a one-off incident with short-term impact. HKRRP was reminded to implement the recommended Environmental Mitigation Implementation Schedule, specifically to ensure all surface runoff generated from work areas are diverted to wastewater treatment facilities prior discharge during construction phase and to implement the mitigation measures as far as practicable, as recommended in the EM&A Program.	Completed
------------	-------------------	-------------------	---------------	-----	---	-----------

WENTX – 04	29 January 2026	30 January 2026	Air Quality	1823 Hotline	A complaint was referred from 1823 on 29 January 2026, regarding the construction dust from Nim Wan Road. As advised by the Contractor, the work carried out near the complaint location on 29 January 2026 included excavation work at Portion A1 and asphalt paving work at Portion B1a. In addition, rock breaking work was carried out at Portion D1 (i.e. Temporary Traffic Arrangement (TTA) at Nim Wan Road near Yung Long Road) on 29 January 2026. Upon receipt of the complaint, joint site inspection were conducted by HKRRP and ET on 30 January 2026 to evaluate the implementation of dust mitigation measures and assess the effectiveness. In addition, EM&A programme has been executed by the ET to monitor the potential environmental impact arising from the Project and to take prompt action in response to any deficiencies found on Site. The closest air quality monitoring station from the complaint location is AM(D)6a which is located at the rooftop of T·PARK workshop. According to the impact monitoring result in 28 and 30 January 2026, no exceedances of environmental performance criteria were recorded for 1-hr TSP monitoring. In our investigation, HKRRP implemented dust mitigation measures at to reduce potential dust impact to nearby environment, and no dust monitoring exceedances were recorded on 28 and 30 January 2026. Nevertheless, HKRRP was reminded to implement the recommended Environmental Mitigation Implementation Schedule, and to implement the mitigation measures as far as practicable, as recommended in the EM&A Program.	Completed
------------	-----------------	-----------------	-------------	--------------	--	-----------

WENTX – 05	3 February 2026	6 February 2026	Air Quality	1823 Hotline	A complaint was referred from 1823 on 3 February 2026, regarding the construction dust from road work at Nim Wan Road. As advised by the Contractor, rock breaking work was carried out at Portion D1 (i.e. Temporary Traffic Arrangement (TTA) at Nim Wan Road near Yung Long Road) on 3 February 2026. Upon receipt of the complaint, joint site inspection were conducted by HKRRP and ET on 6 February 2026 to evaluate the implementation of dust mitigation measures and assess the effectiveness. In addition, EM&A programme has been executed by the ET to monitor the potential environmental impact arising from the Project and to take prompt action in response to any deficiencies found on Site. The closest air quality monitoring station from the rock breaking work at Portion D1 is AM(D)5a which is located at Lung Kwu Sheung Tan. According to the impact monitoring result on 3 February 2026, no exceedance of environmental performance criteria was recorded for 1-hr TSP monitoring. In our investigation, HKRRP implemented dust mitigation measures at to reduce potential dust impact to nearby environment, and no dust monitoring exceedance was recorded on 3 February 2026. Nevertheless, HKRRP was reminded to implement the recommended Environmental Mitigation Implementation Schedule, and to implement the mitigation measures as far as practicable, as recommended in the EM&A Program.	Completed
------------	-----------------	-----------------	-------------	--------------	--	-----------

WENTX – 06	18 March 2026	30 March 2026	Construction Noise	EPD	A complaint was referred from EPD regarding the night time construction noise on the night of 17 March 2026. Upon received the complaint, SM reviewed on the Site Diary records and Contractor's site records indicated that the construction during the concerned period were conducted in compliance with the valid Construction Noise Permit (Permit No. GW-RW0138-26). The construction activities comply with the requirements stipulated in the EM&A Manual. The Contractor HKRRP advised that the potential noise source could be associated with the closing of mine truck tailgates during material unloading, and instructed dump trucks/mine trucks to close their tailgates slowly to minimize the metal-to-metal banging noise generated from closing the tailgates. During the investigation, intermittent metallic noise was detected from mine truck, and noise associated with material unloading and closing of mine truck tailgates was also detected/heard at the unloading area. In the investigation, the noise source of the complaint was concluded related to the Project. HKRRP proposed and implemented noise reduction mitigation measures (e.g. install rubber padding at the tailgate (in progress) and replace the metal bars on mine truck to eliminate noise caused by collision of metal components during operation) to minimize metal-to-metal banging noise generated from closing the tailgate upon received the complaint. Nevertheless, HKRRP was reminded to strictly implement the Environmental Mitigation Implementation Schedule, and to implement the noise mitigation measures as far as practicable, as recommended in the EM&A Program.	Completed
------------	---------------	---------------	--------------------	-----	---	-----------

WENTX – 07	5 June 2026	8 June 2026	Air Quality	1823 Hotline	A complaint was referred from 1823 on 5 June 2026, regarding the dust from Nim Wan Road and dust suspension matter along Nim Wan Road. As advised by the Contractor, trial pit excavation and concrete works was carried out at 132kV TTA & C2 TTA (i.e. Temporary Traffic Arrangement (TTA) at Nim Wan Road on 1 June 2026 Regular weekly site inspection were conducted by SM, HKRRP and ET on 28 May and 4 June 2026 and no dust related issue had been identified at Nim Wan Road. Moreover, upon receipt of the complaint, ad-hoc site inspections were conducted by the SM and IEC on 10 June 2026 to check the implementation of dust mitigation measures and assess their effectiveness. During the inspection, no dusty emissions were observed at 132kV TTA, C2 TTA or Nim Wan Road. Additionally, it was observed that an air quality mitigation measure, i.e., watering on Nim Wan Road carried out by a water truck. Furthermore, monthly site inspection were conducted by the SM, HKRRP, IEC and ET on 11 June 2026, the relative dust control measures along Nim Wan Road had been observed during the site inspection. In addition, EM&A programme has been executed by the ET to monitor the potential environmental impact arising from the Project and to take prompt action in response to any deficiencies found on Site. The closest air quality monitoring station from the Nim Wan Road works area 132kV TTA, C2 TTA are AM(D)6a & AM(D)5a respectively which are located at the Rooftop of T-Park Workshop and Lung Kwu Sheung Tan. According to the impact monitoring result on 29 May and 2 June 2026, no exceedance of environmental performance criteria was recorded for 1-hr and 24-Hr TSP monitoring at both monitoring stations. In our investigation, HKRRP implemented dust mitigation measures to reduce potential dust impact on nearby environment, and no dust monitoring exceedance was recorded on 29 May and 2 June 2026. There is no evidence that the dust issue at Nim Wan Road created due to the project. Therefore, it was concluded that the complaint is not Project related.	Completed
------------	-------------	-------------	-------------	--------------	--	-----------

Appendix M

Environmental Mitigation Implementation Schedule

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix B1 – Air Quality

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
<i>Air Quality</i>							
S3.8.1	A1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation. - Dust emission from construction vehicle movement is confined within the worksites area. - Watering facilities will be provided at every designated vehicular exit point. - Watering will be carried out 8 times per day during construction phase.	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	Entire WENT Landfill Extension site	Construction and Restoration phases	To control the dust impact to within the EM&A criteria (Ref. 1-hr and 24-hr TSP levels are $500\mu\text{gm}^{-3}$ and $260\mu\text{gm}^{-3}$, respectively)
S3.8.2	A2	The following measures shall be exercised for stack discharge from Ammonia Stripping Plant (ASP), Flare and LFG Power Generator: - The maximum allowable discharge limit and pollutant removal efficiency for ASP, flare and LFG power generator should be specified in the design specification. - Owing to the requirement for the installation of stack, the design requirement shall be submitted to IEC and SM for vetting by the Contractor. - Subject to the subsequent EPD's requirement on chimney installation, regular stack monitoring of air pollutants, including NO_x, SO₂, RSP, NMOCs, vinyl chloride, and benzene shall be carried out at a quarterly interval (i.e. once every 3 months), and the operating conditions, including exhaust gas temperature and velocity shall be monitored continuously in order to demonstrate compliance during the operations. - A monthly monitoring report should be prepared by ET and submitted to IEC and SM for approval.	Minimize the release of harmful air pollutant to the atmosphere	Contractor	Flare, ASP and LFG Power Generator of WENT Landfill Extension	Design, Operation and Restoration phases	TM-EIA, Annex 4

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A3	The following measures shall be exercised for the VOC surface emission: - The arrangement of the landfill gas collection system and surface covering material for inactive tipping area shall be reviewed by Contractor every 5 years to identify any modern technology/arrangement (covering material, LFG well spacing and locations). A working team shall be formulated to review all processes, control practice and extraction system in order to maximize the efficiency of the system. A review report should be prepared by the Contractor for the submission to SM and IEC on the implementation/arrangement of LFG extraction system. The first review report should be submitted to SM and IEC for agreement before commencement. With a good system to collect LFG (high extraction efficiency), surface release of VOC to the nearby environment can be much reduced or utilised. - Maintain a slightly negative pressure within the entire tipping area (by suction). Minimise any potential leakage of LFG to the surrounding by increase the number of gas-extraction wells. Improve the extraction efficiency by checking/reinstate gas wells with abnormally low extraction rate due to blockage/soil movement or sedimentation. - Increase the coverage of inactive tipping phases with HDPE/plastic sheet which can enhance the anaerobic decomposition (reduce air getting in and VOC leaking out). - EM&A will be conducted at ASR to establish the future VOC ambient level. This monitoring work should be carried out in a frequency once every 3 months. By comparing the monitoring data at the boundary and at ASR, the cause of VOC and the general downwind dispersion effect (dilution effect) from the boundary to the ASR can be identified. The findings of the monitoring should be incorporated into the landfill gas collection system review report as mentioned above.	Minimize the release of harmful VOC to the environment	Contractor	Active, Inactive and Restored Tipping areas	Design, Before commencement of Operation, Operation and Restoration phases	• TM-EIA, Annex 4

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A4	The following design options shall be considered in the future leachate treatment plants: - Adopted updated treatment method such as Sequencing Batch Reactor for future leachate treatment. Provision of ventilated cover for the leachate storage lagoons / tanks and emissions extracted to suitable odour removal filters with odour removal efficiency of 99%. - Ferric nitrate or sodium hypochlorite can be added to oxidise the odourous chemical in the leachate. The pH value of leachate can be controlled to a suitable value from future onsite experiment such that the generation of any odourous H₂S and ammonia can be optimised. - The locations of discharge points and discharge heights should be in accordance with the assumptions adopted in the EIA Report and VEP supporting document. If the future locations / heights of the stacks deviate from the assumptions adopted in the EIA Study VEP supporting document, reassessment of the air quality impact should be conducted. - The overall arrangement should be investigated in details by the Contractor and agreed with IEC and EPD.	Environmental Enhancement to improve the air quality and visual impact to nearby sensitive receivers	Contractor	Leachate treatment plants	Design, Operation and Restoration phases	• Environmental Enhancement
S3.8.2	A5	The following are some odour precautionary measures that shall be considered by EPD and FEHD: - As an improvement measure to enhance to environmental standard for waste transfer, EPD could take the initiative to recommend others to use enclosed type RCV in the long run (dominantly government and sludge types). - Clearing / watering of the surface and clearing of the waste water receptor of government RCV is recommended before leaving refuse transfer station or government Refuse Collection Point (FEHD).	Environmental Enhancement to improve the odour impact during the transit of waste	EPD, FEHD	Government RCV from RTS and RCP	Operation phase	• Environmental Initiative

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A6	The Contract shall exercise adequate precautionary measures to minimize any potential odour nuisance from tipping activities: - Planting rows of trees along the northern side of WENT Landfill Extension (ie slope toe) and along Nim Wan Road. - Providing a vehicle washing facility before the exit of the landfill and providing sufficient signage to remind Refuse Collection Vehicles (RCV) drivers to pass through the facility before leaving the landfill. - Reminding the RCV drivers to empty the liquor collection sump and close the valve before leaving the tipping face. - Washing down the area where spillage of RCV liquor is discovered promptly. - Reminding operators to properly maintain their RCVs properly and that liquor does not leak from the vehicles. - Installation of vertical and/or horizontal LFG extraction system to enhance extraction of LFG from the waste mass and hence minimise odour associated with fugitive LFG emissions. - Progressive / temporary restoration of the areas which reach the finished profile (a final capping system including an impermeable liner will be put in place) and installation of a permanent LFG extraction system. - Daily cover the compacted waste with 150mm of soil. - Covering the non-active phase with 300mm to 600mm of soil / an impermeable liner (on top of the intermediate cover), which will not only prevent odour emissions from landfilled waste but also enhance LFG extraction by the LFG extraction system. - Providing deodoriser for the LTP. - Enclosing all the leachate storage and treatment tanks and diverting the exhaust air from these tanks to a deodoriser to avoid potential odour emissions from the LTP. - As an improvement measure to enhance to environmental standard for waste transfer, EPD could take the initiative to recommend others to use enclosed type RCVs (dominantly government vehicles and sludge vehicles).	Minimize the potential odour impact for tipping area to nearby sensitive receivers	Contractor	Tipping areas	Operation and Restoration phases	- TM-EIA, Annex 4 - Odour patrol with 2 Odour Level or below at ASR without causing potential odour nuisance

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		• Cleaning / watering of the surface and clearing of the waste water receptor of government RCV is recommended before leaving refuse transfer station or government Refuse Collection Point (FEHD). • The trench for special waste shall be covered with soil immediately upon the disposal of special waste to reduce the odour emission. • For Waste requiring co-disposal (e.g., special waste) by trench, the open trench shall be covered with a mobile de-odouriser cover when the trench is not in use for waste disposal, including the time interval between two consecutive disposal operations. • The use of alternative daily cover (less permeable layer) instead of inert material should be considered under worst-case weather condition, subject to EM&A Programme. • The use of immediate daily cover for odorous waste such as animal waste etc. under critical condition should also be considered, subject to EM&A Programme. • In accordance with some reference from New Zealand, odour from active tipping area can be much reduced if the waste is covered by sandwich covering material such that it is confined in a solid/semi solid condition. Such covering material will be acted as sandwich protective layers to block the interaction of waste. Only diffusion mode (small scale) will be present. These would be applied during very hot and stable weather condition. Twice daily covering (mid day and close of business) can be arranged in case odour patrol identify potential odour nuisance, subject to EM&A Programme. • Posi-shell and/or other suitable materials will be applied to cover the active tipping face at the end of each operation day according to the Enhanced Scheme. • There will also be immediate cover of 300 mm thick soil on the special trench for special wastes.					

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S3.8.2	A6 (Con't)	- Continue to maintain the integrity of the capping system. - Provision of vertical and/or horizontal LFG extraction system to enhance extraction of LFG from the waste mass and hence minimise odour associated with fugitive LFG emissions. - Enclosing all the leachate storage and treatment tanks and diverting the exhaust air from these tanks to a deodoriser to avoid potential odour emissions from the LTP.	Minimize the potential odour impact for tipping area to nearby sensitive receivers	Contractor	Entire WENT Landfill Extension Site	Aftercare phase	- TM-EIA, Annex 4 - Odour patrol with 2 Odour Level or below at ASR without causing potential odour nuisance
Specific measure from VEP							
		- Regular watering on construction / restoration workfronts, haul roads, stockpiling areas etc (at least once per hour). - The quantity of explosive used at each time and spacing of shot holes shall be carefully designed. Blast nets, screens and other protective covers shall be adopted to prevent any fly rocks resulting from blasting activities. - The areas within 30 m from the blasting area will be wetted with water prior to blasting, - Blasting shall not be carried out when the strong wind signal or tropical cyclone warning signal No. 3 or higher is hoisted. Water spraying shall be conducted immediately after each blasting to avoid dispersion of dust. - For marine emissions, on-shore power supply shall be provided where practicable for the construction barges and marine vessels to power the cranes and other machinery on the barges / vessels at the berths to avoid emission from idling at the berth. - The crushers, including the inlets and outlets will be enclosed and ducted to a dust extraction and collection system such as fabric filter in accordance with “A Guidance Note on the Best Practicable Means for Mineral Works (Stone Crushing Plants) (BPM 11/1(95))”. - All transfer points and conveyor belts will also be enclosed. - Water spraying system will be installed at all feeding and outlet areas to	Good construction site practices to control the dust impact at the nearby sensitive receivers to within the relevant criteria.	Contractor	Entire WENT Landfill Extension site	Construction and Restoration phases	To control the dust impact to within the EM&A criteria (Ref. 1-hr and 24-hr TSP levels are 500µgm⁻³ and 260µgm⁻³, respectively)

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		further suppress dust emission. The contractor shall also apply and obtain the license from EPD for operation of the rock crushing plants under the Air Pollution Control Ordinance and ensure the rock crushing plants designed and operated in accordance with BPM 11/1(95). • Posi-shell and/or other suitable materials will be applied to cover the active tipping face at the end of each operation day according to the Enhanced Scheme. • There will also be immediate cover of 300 mm thick soil on the special trench for special wastes.					

Notes :

Entire WENT Landfill Extension site includes Office, Waste Reception Area, Leachate Treatment Works, LFG Treatment Works, Active, Inactive and Restored Tipping Areas.

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix B2 – Noise

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Construction Noise							
S4.4.3.1	N1	Use of good site practices to limit noise emissions by considering the following: - only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; - machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; - plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; - silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; - mobile plant should be sited as far away from NSRs as possible and practicable; - material stockpiles, mobile container site office and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities.	Control construction airborne noise by means of good site practices	Contractor	Entire site construction	Construction phase	• Noise Control Ordinance
S4.4.3.2	N2	Select “Quiet plants” which comply with the BS 5228 Part 1 or TM standards.	Reduce the noise levels of plant items	Contractor	Entire site construction	Construction phase	• Noise Control Ordinance & its TM • Annex 5, TM-EIA
Operation Noise							
S4.6.2	N3	Select “Quiet plants” which comply with the BS 5228 Part 1 or TM standards.	Reduce the noise levels of plant items	Contractor	Entire site construction	Operation and Restoration phases	• Noise Control Ordinance & its TM • Annex 5, TM-EIA
S4.6.2	N4	Build a noise bund of about 3.5m tall along the north eastern seafront of the existing WENT Landfill to provide a screening effect of at least 5dB(A) from the berths.	Reduce the noise levels of barges	Contractor	Existing Landfill WENT	Construction, operation and restoration phases	• Noise Control Ordinance & its TM • Annex 5, TM-EIA

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix B3 – Water Quality

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Construction Water Quality							
S5.6.7	W1	<u>Construction Runoff</u> - At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. - The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a site/sediment trap. The sediment/silt traps should be incorporated in the permanent drainage channels to enhance deposition rates. - The design of efficient silt removal facilities should be based on the guidelines in ProPECC PN 2/23, which states that the retention time for silt/sand traps should be 5 minutes under maximum flow conditions. - Construction works should be programmed to minimize surface excavation works during the rainy seasons (April to September). All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. If excavation of soil cannot be avoided during the rainy season, or at any time of year when rainstorms are likely, exposed slope surfaces should be covered by tarpaulin or other means. - All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas. - Measures should be taken to minimise the ingress of site drainage into excavations. If the excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities. - Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50 m³ should be covered with tarpaulin or similar	Control construction runoff and erosion from site surface, drainage channel, stockpiles, barging facility, wheel washing facilities, etc to minimize water quality during construction stage	Contractor	Entire site	Construction phase	- ProPECC PN 2/23 - Water Pollution Control Ordinance

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system. • Manholes (including newly constructed ones) should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers. • Precautions to be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC PN 2/23. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes. • All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and sited wheel washing bay should be provided at every construction site exit. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel-wash bay to the public road should be paved with sufficient backfall toward the wheel-wash bay to prevent vehicle tracking of soil and silty water to public roads and drains. • Oil interceptors should be provided in the site drainage system downstream of any oil/fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain. • Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts. Requirements for solid waste management are detailed in Section 6 of this Report. • All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby.					

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S5.6.7	W2	<u>Sewage Effluent from Workforce</u> - Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance. - Notices will be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment during the construction phase of the Project. - Regular environmental audit on the construction site can provide an effective control of any malpractices and can achieve continual improvement of environmental performance on site.	Control sewage effluent arising from the sanitary facilities provided for the onsite construction workforce	Contractor	On-site sanitary facilities	Construction phase	• ProPECC PN 2/23 • Water Pollution Control Ordinance • Waste Disposal Ordinance
S5.6.7	W3	<u>Accidental Spillage of Chemical</u> Any service workshop and maintenance facilities shall be located within a bunded area, and sumps and oil interceptors shall be provided. Maintenance of equipment involving activities with potential for leakage and spillage will only be undertaken within the areas.	Control of chemical leakage	Contractor	Service workshop and maintenance facilities	Construction phase	• ProPECC PN 2/23 • Water Pollution Control Ordinance • Waste Disposal Ordinance

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Operation Water Quality							
S5.7.8	W4	<u>Erosion Control Measures</u> a. Preserve Natural Vegetation This Best Management Practices will involve preserving natural vegetation to the greatest extent possible during the construction process, and after construction where appropriate. Maintaining natural vegetation is the most effective and inexpensive form of erosion prevention control. b. Provision of Buffer Zone A buffer zone consists of an undisturbed area or strip of natural vegetation or an established suitable planting adjacent to a disturbed area that reduces erosion and runoff. The rooted vegetation holds soils acts as a wind break and filters runoff that may leave the site. c. Seeding (Temporary/Permanent) A well-established vegetative cover is one of the most effective methods of reducing erosion. Vegetation should be established on construction sites as the slopes are finished, rather than waiting until all the grading is complete. Besides, Hydroseeding will be applied on the surface of stockpiled soil and on temporary soil covers for inactive tipping areas to prevent soil erosion during rainy season. d. Ground Cover Ground Cover is a protective layer of straw or other suitable material applied to the soil surface. Straw mulch and/or hydromulch are also used in conjunction with seeding of critical areas for the establishment of temporary or permanent vegetation. Ground cover provides immediate temporary protection from erosion. Mulch also enhances plant establishment by conserving moisture, holding fertilizer, seed, and topsoil in place, and moderating soil temperatures. e. Hydraulic Application Hydraulic application is a mechanical method of applying erosion control materials to bare soil in order to establish erosion-resistant vegetation on disturbed areas and critical slopes. By using hydraulic equipment, soil amendments, mulch, tackifying agents, Bonded Fiber Matrix (BFM) and liquid co-polymers can be uniformly broadcast, as homogenous slurry, onto the soil. These erosion and dust control materials can often be applied in one operation.	Erosion control	Contractor	Drainage system	Construction, Operation, Restoration and Aftercare phases	• ProPECC PN 2/23 • Water Pollution Control Ordinance

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		f. Sod Establishes permanent turf for immediate erosion protection and stabilizes rainageways. g. Matting There are numerous erosion control products available that can be described in various ways, such as matting, blankets, fabric and nets. These products are referred as matting. A wide range of materials and combination of materials are used to produce matting including, but not limited to: straw, jute, wood fiber, coir (coconut fiber), plastic netting, and Bonded Fiber Matrix. The selection of matting materials for a site can make a significant difference in the effectiveness of the Best Management Practices. h. Plastic Sheeting Plastic Sheeting will provide immediate protection to slopes and stockpiles. However, it has been known to transfer erosion problems because water will sheet flow off the plastic at high velocity. This is usually attributable to poor application, installation and maintenance. i. Dust Control Dust Control is one preventative measure to minimize the wind transport of soil, prevent traffic hazards and reduce sediment transported by wind and deposited in water resources.					
S5.7.8	W5	Temporary surface water drainage system will be provided to manage runoff during construction and operation. This system will consist of channels as constructed around the perimeter of the site area. This system will collect surface water from the areas of higher elevations to those of lower elevations and ultimately to the point of discharge. Erosion will therefore be minimised. The temporary surface water drainage system will include the use of a silt fence around the soil stockpile areas to prevent sediment from entering the system. Regular cleaning will be carried out to prevent blockage of the passage of water flow in silt fence. Intermediate drainage system will be installed for filled cell/phase. The major purpose of the intermediate drainage system is to prevent the clean surface water run-off from the filled phases coming into contact with the waste mass in active cell and to prevent excessive surface water infiltration through the intermediate cover, thus contribute to increasing volume of leachate. The intermediate drainage system will collect the clean surface water run-off and	Surface Water Management / Control run off	Contractor	Surface water system	Construction, Operation, Restoration and Aftercare phases	• Water Pollution Control Ordinance • TM-water

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		divert it to the permanent discharge channels connected to the public drainage system. In addition, surface flow from the haul road (especially near the wheel washing facility) will be collected to a dry weather flow interceptor and conveyed to the on-site leachate treatment plant for further treatment.					
S5.7.8	W6	Monitoring of the surface water discharges and groundwater discharge under the environmental monitoring programme.	Control run off and underground water leakage	Contractor	Surface and underground water system	Operation, Restoration and Aftercare phases	• Water Pollution Control Ordinance • TM-water
S5.7.8	W7	Formulate contingency Plan on Accidental Leakage of Leachate • Design Contingency Plan for Groundwater Contamination • Design Contingency Plan for Surface Water Contamination	Control contamination to surface and ground water	Contractor	Drainage system	Operation, Restoration and Aftercare phases	• TM-water • Water Pollution Control Ordinance

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix B4 – Waste Management

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Waste Management							
S6.5	WM1	<u>C&D Materials</u> Implement proper waste management measures during construction phase as stipulated in the Environmental Management Plan (EMP) in accordance with the ETWB TC(W) No. 19/2005 Environmental Management in Construction Sites. Implement a trip-ticket system to ensure that the movement of C&D materials are properly documented and verified in accordance with TCW No. 6/2010. Copies/counterfoils from trip-tickets (with quantities of C&D Materials off-site) should be kept for record purposes. Appropriate waste management should be implemented in accordance with the ETWB TC(W) No 19/2005. Make provisions in Contract documents to allow and promote the use of recycled aggregates where appropriate. Careful design, planning and good site management to minimise overordering and waste materials such as concrete, mortars and cement grouts. The design of formwork should maximise the use of standard wooden panels so that high reuse levels can be achieved. Alternatives such as steel formwork or plastic fencing should be considered to increase the potential for reuse. The Contractor should recycle as much as possible the C&D waste on-site through proper waste segregation on-site. Concrete and masonry should be used as general fill and steel reinforcement bars can be used by scrap steel mills. Proper areas should be designated for waste segregation and storage wherever site conditions permit. Maximise the use of reusable steel formwork to reduce the amount of C&D material. Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement. On-site sorting and segregation facility of all type of wastes is considered as one of the best practice in waste management and hence, should be implemented in all projects generating construction waste. The sorted public fill and C&D waste should be properly reused. Excavated slope, stockpiled material and bund walls should be covered by tarpaulin until used in order to prevent wind-blown dust during dry weather, and to reduce muddy runoff during wet weather. Appropriate measures to minimise windblown litter and dust during transportation of waste by either covering trucks or by transporting wastes in enclosed containers. If any topsoil-like materials need to be stockpiled for any length of time,	Good site practice to minimise C&D waste generation and reuse/recycle all C&D on-site as far as possible	Contractor	Entire site construction	Construction phase	Waste Disposal Ordinance ETWB TC(W) No.19/2005 TCW No. 6/2010

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		consideration should be given to hydroseeding of the topsoil on the stockpile to improve its visual appearance and prevent soil erosion. Nomination of approved personnel to be responsible for good site practices and making arrangements for collection of all wastes generated on-site and effective disposal. Training of site personnel for cleanliness, proper waste management procedures including chemical waste handling, and waste reduction, reuse and recycling concepts. Regular cleaning and maintenance programme for drainage systems, sumps and oil interceptors. Prior to disposal of C&D waste, wood, steel and other metals should be separated for re-use and/or recycling to minimise the quantity of waste to be disposed of to landfill. Proper storage and site practices should be implemented to minimise the potential for damage or contamination of construction materials. Plan and stock construction materials carefully to minimise amount of waste generated and avoid unnecessary generation of waste. Minimise excessive ordering of concrete, mortars and cement grout by doing careful check before ordering.					
S6.5	WM2	<u>Chemical Waste</u> Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Plant/equipment maintenance schedule should be designed to optimise maintenance effectiveness and to minimise the generation of chemical wastes. Where possible, chemical wastes (e.g. waste lube oil) should be recycled by licensed treatment facilities Containers used for storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed; have a capacity of less than 450 liters unless the specification has been approved by the EPD. Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Regulation. The storage area for chemical wastes should be clearly labelled and used solely for storage of chemical waste, enclosed with at least 3 sides, having an	Ensure proper disposal of chemical waste generated on-site to minimise the associated hazards on human health and environment	Contractor	Entire construction site	Construction, Operation, Restoration and Aftercare phases	Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
		impermeable floor and bund of sufficient capacity to accommodate 110% of volume of the largest container or 20 % of total volume of waste stored in that area, whichever is the greatest, having adequate ventilation, being covered to prevent rainfall entering, and being arranged so that incompatible materials are adequately separated. Chemical waste should be collected by licensed waste collectors and disposed of at licensed facility, e.g. Chemical Waste Treatment Centre.					
S6.5	WM3	<u>General Refuse</u> General refuse generated on-site should be properly stored in enclosed bins or compaction units separately from construction and chemical wastes. All recyclable materials (separated from the general waste) should be stored on-site in appropriate containers with cover prior to collection by a local recycler for subsequent reuse and recycling. Residual, nonrecyclable, general waste should be stored in appropriate containers to avoid odour. Regular collection should be arranged by an approved waste collector in purpose-built vehicles that minimise environmental impacts during transportation Reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimise odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminum cans should be separated from general waste stream and collected by recyclers. Proper collection bins should be provided on-site to facilitate the waste sorting. Office waste paper should be recycled if the volume warrant collection by recyclers. Participation in community waste paper recycling programme should be considered by the Contractor, including waste paper, aluminum cans, plastic bottles, waste batteries, etc.	Minimise generation of general refuse to avoid odour, pest and visual nuisance	Contractor	Entire construction site	Construction, Operation, Restoration and Aftercare phases	Waste Disposal Ordinance
S6.5	WM4	<u>Sludge from Leachate Treatment Works</u> Sludge should be collected by a licensed collector at regular intervals, to suit the operation schedule of the leachate treatment plant. The use of purpose-built sludge tankers can minimise the potential of environmental impacts during transportation.	Proper management of sludge arising from leachate treatment works to minimise the associated hazards on human health and environment	Contractor	Leachate Treatment Works	Construction, Operation, Restoration and Aftercare phases	Waste Disposal Ordinance

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix B5 – Landfill Gas

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
LFG							
Within WENT Landfill Extension							
S7.6.1	LFG1	Special LFG precautions should be taken due to close proximity of WENT Landfill Extension site to existing landfill to avoid potential hazards of LFG exposure (ignition, explosion, asphyxiation, toxicity).	To minimise the risk of LFG hazards to personnel in construction site	Contractor	Entire Landfill site WENT Extension	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.1	LFG2	Prominent safety warning signs should be erected on-site to alert all personnel and visitors of LFG hazards during excavation works.					
S7.6.1	LFG3	No smoking or burning should be permitted on-site.					
S7.6.1	LFG4	Prominent 'No smoking' and 'No Naked Flames' signs should be erected on-site.					
S7.6.1	LFG5	No worker should be allowed to work alone at any time in excavated trenches or confined areas on-site.					
S7.6.1	LFG6	Adequate fire fighting equipment should be provided on-site.					
S7.6.1	LFG7	Construction equipment should be equipped with vertical exhaust at least 0.6m above ground installed with spark arrestors.					
S7.6.1	LFG8	Electrical motors and extension cords should be explosion-proof and intrinsically safe for use on-site.					
S7.6.1	LFG9	'Permit to Work' system should be implemented.					
S7.6.1	LFG10	Welding, flame-cutting or other hot works should be conducted only under 'Permit to Work' system following clear safety requirements, gas monitoring procedures and presence of qualified persons to supervise the works.					
S7.6.1	LFG11	For piping assembly or conduit construction, all valves and seals should be closed immediately after installation to avoid accumulation and migration of LFG. If installation of large diameter pipes (diameter >600mm) is required, the pipe ends should be sealed on one side during installation. Forced ventilation is required prior to operation of installed pipeline. Forced ventilation should also be required for works inside trenches deeper than 1m.					

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S7.6.1	LFG12	Frequency and location of LFG monitoring within excavation area should be determined prior to commencement of works. LFG monitoring in excavations should be conducted at no more than 10mm from exposed ground surface.	To minimise the risk of LFG hazards to personnel in construction site	Contractor	Entire WENT Landfill Extension site	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97)
S7.6.1	LFG13	For excavation works deeper than 1m, LFG monitoring should be conducted (1) at ground surface prior to excavation, (2) immediately before workers entering excavations, (3) at the beginning of each working day for the entire period of excavation remains open, and (4) periodically throughout the working day when workers are in the excavation.					Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations
S7.6.1	LFG14	Any cracks on ground level encountered on-site should be monitored for LFG periodically. Appropriate action should be taken in accordance with the action plan in Table 7.8 of EIA Report.					Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.1	LFG15	LFG precautionary measures involved in excavation and piping works should be provided in accordance with LFG Guidance Note and included in Safety Plan of construction phase. Temporary offices or buildings should be located where free LFG has been proven or raised clear of ground at a separation distance of at least 500mm.					
S7.6.1	LFG16	For large development such as WENT Landfill Extension, a Safety Officer trained in the use of gas detection equipment and LFG-related hazards should be present on-site throughout the groundwork phase. The Safety Officer should be provided with an intrinsically safe portable instrument appropriately calibrated and capable of measuring the following gases: - CH₄: 0-100% LEL and 0-100% v/v - CO₂: 0-100% v/v - O₂: 0-21% v/v					

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S7.6.1	LFG17	Periodically during groundwork construction, the works area should be monitored for CH ₄ , CO ₂ and O ₂ using appropriately calibrated portable gas detection equipment. The monitoring frequency and areas should be established prior to commencement of groundwork either by Safety Officer or appropriately qualified person. Routine monitoring should be carried out in all excavations, manholes, chambers and any other confined spaces that may have been created by temporary storage of building materials on-site. All measurements in excavations should be made with monitoring tube located not more than 10mm from exposed ground surface.	To minimise the risk of LFG hazards to personnel in construction site	Contractor	Entire WENT Landfill Extension site	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97)
S7.6.1	LFG18	For excavations deeper than 1m, measurements should be conducted: - At ground surface before excavation commences; - Immediately before any worker enters the excavation; - At the beginning of each working day for entire period the excavation remains open; and - Periodically throughout the working day whilst workers are in excavation.					Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations
S7.6.1	LFG19	For excavations between 300mm and 1m, measurements should be conducted: - Directly after excavation has been completed; and - Periodically whilst excavation remains open.					Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.1	LFG20	For excavations less than 300mm, monitoring may be omitted at the discretion of Safety Officer or appropriately qualified person.					
S7.6.1	LFG21	Where any service voids, manholes and inspection chambers within WENT Landfill Extension site are entered for maintenance and LFG monitoring, all safety requirements should be followed.	To minimise the risk of LFG hazards to personnel in landfill site	Contractor	Entire WENT Landfill Extension site	Construction, Operation, Restoration and Aftercare phases	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97)
S7.6.1	LFG22	Buildings onsite should be incorporated with passive system relying on natural air movement to prevent gas build-up and active system requiring energy input to mechanically move air to protect against LFG build-up. Design measures for sub-surface building services should include generic measures e.g. gas barriers, gas vents and strategic routing of any service utilities away from potential LFG migration pathways.					Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations
							Code of Practice on Safety and Health at Work in Confined Spaces

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
S7.6.1	LFG23	Any new-built permanent building structures within the WENT Landfill Extension site, forced ventilation and gas detection system with audible alarm should be installed. When the internal atmosphere is detected with >10% of CH ₄ , forced ventilation should be triggered automatically. No person should be allowed to enter or remain in any confined areas when CO ₂ levels >1.5% v/v or O ₂ levels <18% v/v were detected. Access to confined spaces in the WENT Landfill Extension site should be controlled to only authorised persons.	To minimise the risk of LFG hazards to personnel in landfill site	Contractor	Entire WENT Landfill Extension site	Construction, Operation, Restoration and Aftercare phases	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.1	LFG24	Specific gas protection measures which can be applied to building services have been in Appendix 7.4 of EIA Report. They generally include gas barriers, gas vents, location of service entries above ground, and service conduits passing through Consultation Zone.					
S7.6.3	LFG25	The design of the landfill gas protection measures to be adopted onsite, e.g. utilities, buildings, LFG cut-off trench barrier, monitoring wells and facilities related to the WENT Landfill Extension project will be performed by a landfill gas specialist consultant appointed by the Contractor. Moreover, the landfill gas protection measures will be checked and certified by a qualified independent consultant. The contractor shall ensure that the required protective measures are implemented and constructed in accordance with the design and shall establish a maintenance and monitoring programme for ensuring the continual performance of the implemented protection measures. The above requirements shall be included in the tender documents of WENT Landfill Extension project. When the detailed design is available, the Contractor is required to undertake further landfill gas hazard assessment to take account of the more readily available detailed information to finalise the design of the landfill gas protection measures recommended in this report. During the future detailed design stage, a review of the preliminary qualitative LFG hazard assessment presented in the report will be carried out, a detailed qualitative LFG hazard assessment will be prepared and all the report together with the detailed design of gas protection measures will be submitted to EPD for vetting.	To ensure that the design of the landfill gas protection measures is in order and appropriate.	The Project Proponent, Contractor	Entire WENT Landfill Extension site	Detailed Design stage	

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Precautionary / Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of the Recommended Measures & Main Concerns to address	Who to implement the measures?	Location of the measures	When to implement the measures?	What requirements or standards for the measures to achieve?
Outside WENT Landfill Extension							
S7.6.2	LFG26	Setting up a LFG cut-off trench barrier is one of the mitigation measures for preventing gas entering an area. Since there are no "design equations" for cut-off barrier specifications, it is therefore essential to seek expert recommendation before finalising the design detail of any cut-off barrier. LFG cut-off trench barrier should be built along the site boundary of the WENT Landfill Extension to prevent gas from entering an area, which is keyed into low permeability strata or extends at least 1m below the lowest groundwater level. To relieve the potential build up of gas, it may be necessary to install additional measures for venting the gas such as trenches filled with no-fines, granular material, e.g. gravel, connected to venting pipes which will provide a preferential pathway for the release of gas to atmosphere.	To cut off any gas migration from WENT Landfill Extension to the middle lagoon and T Park which falls into the 250m LFG consultation zone of WENT Landfill and its Extension.	Contractor	Outside WENT Landfill Extension site	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.2	LFG27	Sealing of fault line ends by grouting will be implemented. In the event that investigation works during the detailed design stage identify the presence of laterally persistent faults running beneath the landfill site, and leading towards sensitive receivers, the following works could be carried out: - Sealing of any surface exposures of the 'fault' feature exposed during the site formation works. This could be carried out through the application of a shotcrete cover prior to the placement of the landfill liner, which also acts as a barrier to landfill gas migration. - Ground treatment at the landfill boundary, comprising pressurized injection of grout within a series of inclined drillholes formed to intersect the fault at various depths. These would effectively form an impermeable barrier against the lateral migration of landfill gas along the fault line. - Adequate venting of landfill gases such that insufficient pressures develop to result in lateral or downward migration of gas.	To prevent gas migration through the fault line in particular to the existing Black Point Power Station.	Contractor	Outside WENT Landfill Extension site	Construction phase	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97) Factories and Industrial Undertakings (F&IU) (Confined Spaces) Regulations Code of Practice on Safety and Health at Work in Confined Spaces
S7.6.2	LFG28	LFG monitoring wells will be installed in the ground on the development side of the cut-off trench barrier to measure the concentration of methane and carbon dioxide. Setting up a LFG cut-off trench barrier is one of the mitigation measures for preventing gas entering an area. Since there are no "design equations" for cut-off barrier specifications, it is therefore	To determine the effectiveness of the cut-off trench barrier in preventing LFG migration.	Contractor	Outside WENT Landfill Extension site	Construction, Operation, Restoration and Aftercare phases	Landfill Gas Hazard Assessment Guidance Note (EPD/TR8/97).

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

		essential to seek expert recommendation before finalising the design detail of any cut-off barrier.					
--	--	---	--	--	--	--	--

Environmental Mitigation Implementation Schedule WENT Landfill Extension

Appendix B6 – Landscape and Visual Impact

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
Landscape and Visual Impact							
S8.7	LV1	Advanced screening tree planting (mitigation measures – MM1) - Early planting using fast growing trees and tall shrubs at strategic locations within site to block major view corridors to the site from the VSRs, and to locally screen haul roads, excavation works and site preparation works. - Tree planting in standard tree size along the slope toe of WENT Landfill Extension.	To minimise the impact on existing vegetation retained by personnel in construction site To provide initiation on permanent landscape and visual mitigation measures	Contractor	Entire construction site	Construction and Operation phases	DEVB TC(W) No. 4/2020 – Tree Preservation ETWB TC(W) No. 6/2015 – Maintenance of Vegetation and Hard Landscape Features WBTC No. 6/2011 – Maintenance of Man-made Slopes and Emergency Repair on Stability of Land
S8.7	LV2	Boundary Green Belt planting (mitigation measures – MM2) Considerable planting belts proposed around the site perimeter and the construction of temporary soil bunds would screen the landfill operations to a certain degree. Fast growing and fire resistant plant species will be used.					
S8.7	LV3	Temporary landscape treatment as green surface cover (mitigation measures – MM3) For certain areas where landfilling operations would have to be suspended temporarily for a certain period of time, simple temporary landscape treatment such as temporary green colour slope cover should be considered. The period of temporary suspended operation should be sufficiently explicit in order to undertake appropriate temporary landscape treatment. During construction and operation phases, synthetic covering material of green colour should also be used as a temporary slope cover where applicable. Given the extensive area of the proposed extension, development of the site should be divided into phases to minimize the visual impact.					
S8.7	LV4	Existing tree preservation (mitigation measures – MM4) No trees should be felled or transplanted unless they are inevitably affected by the Project. Affected trees should be transplanted under circumstances where technically feasible. A tree survey report should be prepared and a tree felling application should be submitted to government during the detailed design stage for approval before site formation works commence. The numbers, locations, species and sizes of the trees to be transplanted or felled should be clearly addressed.					

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
S8.7	LV5	Sensible final contour grading (mitigation measures – MM5) The final landfill will provide a structurally stable and visually interesting landform, which is visually compatible with surrounding landscape and contoured to simulate adjacent undeveloped area. Introduction and continuation of natural features such as spurs, ridges and valleys will be considered where appropriate.	To minimise the visual impact on landfill.	Contractor	Entire construction site	Restoration and Aftercare phases	DEVB TC(W) No. 4/2020 – Tree Preservation ETWB TC(W) No. 6/2015 – Maintenance of Vegetation and Hard Landscape Features WBTC No. 6/2011 – Maintenance of Man-made Slopes and Emergency Repair on Stability of Land
S8.7	LV6	Sufficient cover soil of landfill final capping (mitigation measures – MM6) Sufficient cover soil of landfill final capping will be placed above the low-permeable layer and drainage layer, so as to sustain the proposed planting. The cover soil layer should be a minimum of 500mm in thickness for grassland, a minimum of 700mm for shrubland and 1000mm for woodland. Immediately after the completion of localized earthworks for the cover soil layer, the soil surface should be stabilized and greened by grass hydroseeding prior to subsequent landscape planting.	To provide site preparation for compensatory planting under the requirements of mitigation measures.	Contractor	Entire construction site	Restoration and Aftercare phases	
S8.7	LV7	Landscape planting and maintenance (mitigation measures – MM7) - Planting and maintenance to allow vegetation establishment to match the natural vegetation of the surroundings. - Seedlings of native tree species will be planted in the second phase. - Reprovision of mangroves in some suitable locations inside the project boundary for compensation. - Planting layout to establish a coherent pattern of woodland, shrubland and grassland vegetation. - In the approved WENTX EIA, 21 ha of woodland compensatory planting to be planted after restoration phase. The Enhanced Scheme would largely minimize encroachment onto the woodland resulting in a small area of loss only, i.e. 0.12 ha. In line with the same principle as the approved WENTX EIA (ratio = 5:1 in terms of area), the total compensatory woodland planting area should be around 0.60 ha.	To minimise the landscape and visual impact on the affected planting areas and provide permanent landscape planting under the mitigation measures	Contractor	Entire construction site	Restoration and Aftercare phases	

**Environmental Mitigation Implementation Schedule
WENT Landfill Extension**

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
S8.7	LV8	Woodland vegetation management (mitigation measures – MM8) - Thinning of pioneer trees to be carried out in the period of 5-8 years after the establishment period for each phase of works. - It includes the selective removal of pioneer trees to provide more light and space between trees that is beneficial for growth and natural regeneration of native trees in the woodland planting mix. - Proper maintenance and management for woodland planting is required to provide good quality of compensatory planting. During establishment period of the woodland planting, proper inspection of the death rate of each species in terms of quantity shall be provided and stated in Environmental Permit that forms part of DBO contract.	To maintain the compensatory woodland planting effectively for mitigation measures.	Contractor	Entire construction site	Restoration and Aftercare phases	

Environmental Mitigation Implementation Schedule

WENT Landfill Extension

Appendix C7 – Cultural Heritage

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location of Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
Cultural Heritage Impact							
Construction and Operation Phases							
Under the Enhanced Scheme, the revised boundary will totally avoid encroachment onto the Tsang Tsui Site of Archaeological Interest, graves and temple. No potential cultural heritage impact due to the Project is anticipated, and thus no mitigation measures are required for the Enhanced Scheme.							

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix C8 – Ecology

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
Ecology							
General Protection Measures:							
S10	E1	Restriction of construction activities to the work areas that would be clearly demarcated.	To minimise environmental impacts and therefore potential ecological impacts within and near the construction site	Contractor	Entire construction site	Construction Phase	Practice Note for Professional Persons (ProPECC), Construction Site Drainage (PN2/23) Code of Practice on the Packaging, Labeling and Storage of Chemical Wastes, EPD (2022) ETWB TC(W)) No. 33/2002 Management of Construction and Demolition Material Including Rock TCW No. 6/2010 Trip Ticket System for Disposal of Construction and Demolition Materials ETWB TC(W) No. 15/2003 Waste Management on Construction Sites WBTC No.12/2002, Specifications Facilitating the Use of Recycled Aggregates WBTC Nos. 25/99, 25/99A and 25/99C. Incorporation of Information on Construction and Demolition Material Management in Public Works Subcommittee Papers
S10	E2	Reinstatement of the work areas immediately after completion of the works.					
S10	E3	Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme.					
S10	E4	Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.					
S10	E5	Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs.					
S10	E6	Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works.					
S10	E7	Mobile plant should be sited as far away from NSRs as possible and practicable.					
S10	E8	Material stockpiles, site office and other structures should be effectively utilised, where practicable, to screen noise from on-site construction activities.					
S10	E9	Use of “quiet” plant and working methods.					
S10	E10	Construction phase mitigation measures in the Practice Note for Professional Persons on Construction Site Drainage.					
S10	E11	Design and set up of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction.					
S10	E12	Design and incorporation of silt/sediment traps in the permanent drainage channels to enhance deposition rates and regular removal of deposited silt and grit.					

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives Recommended Measures & Main Concerns to Address	Who to Implement Measures?	Location Measures	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
S10	E13	Minimization of surface excavation works during the rainy seasons (April to September), and in particular, control of silty surface runoff during storm events, especially for areas located near steep slopes.					
S10	E14	Regular inspection and maintenance of all drainage facilities and erosion and sediment control structures to ensure proper and efficient operation at all times and particularly following rainstorms.					
S10	E15	Provision of oil interceptors in the drainage system downstream of any oil/fuel pollution sources.					
Specific Mitigation Measures:							
S10	E17	Survey and transplantation plant species of conservation concern before site clearance, and 2 years of monitoring after transplantation. During the latest field survey in January 2024 and the Transplantation and Management Plan, only three groups of <i>Nepenthes mirabilis</i> (Pitcher Plant) were found and feasible to be transplanted.	To minimise loss of plant species of conservation concern	Contractor	Within and construction site	Before commencement of construction phase	N/A
S10	E18	0.60 ha of woodland compensatory planting after restoration phase. 10-year ecological monitoring of compensatory woodland planting during the after-care phases	To mitigate loss of woodland habitat	Contractor	Entire construction site	Restoration and Aftercare phase	N/A
S10	E20	Survey and translocation of the three fish species of conservation interest before site clearance, including <i>Squaliobarbus curriculus</i> , <i>Osteochilus vittatus</i> and <i>Kuhlia marginata</i>	To provide precautionary measure for fish species of conservation concern	Contractor	Within and near Construction site	Before commencement of construction phase	
S10	E21	Set up water quality monitoring station at Tai Shui Hang Stream	To provide precautionary measure for fish species of conservation concern	Contractor	Tai Shui Hang Stream	Before commencement of construction phase	

Environmental Mitigation Implementation Schedule
WENT Landfill Extension

Appendix B9 – Pulverized Fuel Ash Impact

EIA Ref	EM&A Log Ref	Recommended Mitigation Measures (to be implemented when the trigger level is exceeded, where necessary)	Objectives of Recommended Measures Main Concerns to Address	Who to Implement Measures?	Location of	When to Implement Measures?	What Requirements or Standards for Measures to Achieve?
Pulverized Fuel Ash Impact							
Construction and Operation Phases							
S11.5	PF1	Recommended measures/ good practices are to be considered	To control radon health risk	Contractor	Entire WENT Landfill Extension site	Construction and Operation phases	ProPECC Note PN 1/99 Control of Radon Concentration in New Buildings

Appendix N

Investigation Report

Service Contract No. EP/SP/186/21
West New Territories Landfill Extension (WENTX)

Investigation Report on Environmental Complaint / Enquires

Complaint Log No.	WENTX – 07
Received Date by ET	8 June 2026
Complaint Details	The complainant complained about the dust from Nim Wan Road and dust suspension matter along Nim Wan Road, Tuen Mun, New Territories
Complaint Location	Nim Wan Road
Date of Complaint	1 June 2026
Environmental Aspect	Construction Dust
Complainant	Unwilling to disclose
Complaint Route	Referred from 1823
Investigation Result	1. A complaint was referred from 1823 on 5 June 2026, regarding the dust from Nim Wan Road and dust suspension matter along Nim Wan Road. The case was then referred to ET for investigation. 2. As advised by the Contractor, trial pit excavation and concrete works was carried out at 132kV TTA & C2 TTA (i.e. Temporary Traffic Arrangement (TTA) at Nim Wan Road on 1 June 2026. 3. Regular weekly site inspection were conducted by SM, HKRRP and ET on 28 May and 4 June 2026 and no dust related issue had been identified at Nim Wan Road. 4. Moreover, upon receipt of the complaint, ad-hoc site inspections were conducted by the SM and IEC on 10 June 2026 to check the implementation of dust mitigation measures and assess their effectiveness. During the inspection, no dusty emissions were observed at 132kV TTA, C2 TTA or Nim Wan Road. Additionally, it was observed that an air quality mitigation measure, i.e., watering on Nim Wan Road carried out by a water truck. Furthermore, monthly site inspection were conducted by the SM, HKRRP, IEC and ET on 11 June 2026, the relative dust control measures along Nim Wan Road had been observed during the site inspection. 5. In addition, EM&A programme has been executed by the ET to monitor the potential environmental impact arising from the Project and to take prompt action in response to any deficiencies found on Site. The closest air quality monitoring station from the Nim Wan Road works area 132kV TTA, C2 TTA are AM(D)6a & AM(D)5a respectively which are located at the Rooftop of T-Park Workshop and Lung Kwu Sheung Tan. According to the impact monitoring result on 29 May and 2 June 2026, no exceedance of environmental performance criteria was recorded for 1-hr and 24-Hr TSP monitoring at both monitoring stations. This indicates that the air quality impact to the nearby sensitive receiver was within acceptable level. The locations of air quality monitoring station AM(D)5a & AM(D)6a is shown in <i>Figure 1</i> and the monitoring data is provided in <i>Annex A</i>. 6. In our investigation, HKRRP implemented dust mitigation measures to reduce potential dust impact on nearby environment, and no dust monitoring exceedance was recorded on 29 May and 2 June 2026. Furthermore, to reduce the dust impact from road traffic,

Service Contract No. EP/SP/186/21
West New Territories Landfill Extension (WENTX)

Investigation Report on Environmental Complaint / Enquires

	HKRRP has implemented enhanced dust control measures by increasing the water spraying frequency along Nim Wan Road from once per day to three times per day. 7. According to the pervious sections, there is no evidence that the dust issue at Nim Wan Road created due to the project. Therefore, it was concluded that the complaint is not Project related. Nevertheless, HKRRP was reminded to implement the recommended Environmental Mitigation Implementation Schedule, and to implement the mitigation measures as far as practicable, as recommended in the EM&A Program.
--	---

Figure 1 Location of Air Quality Monitoring Stations

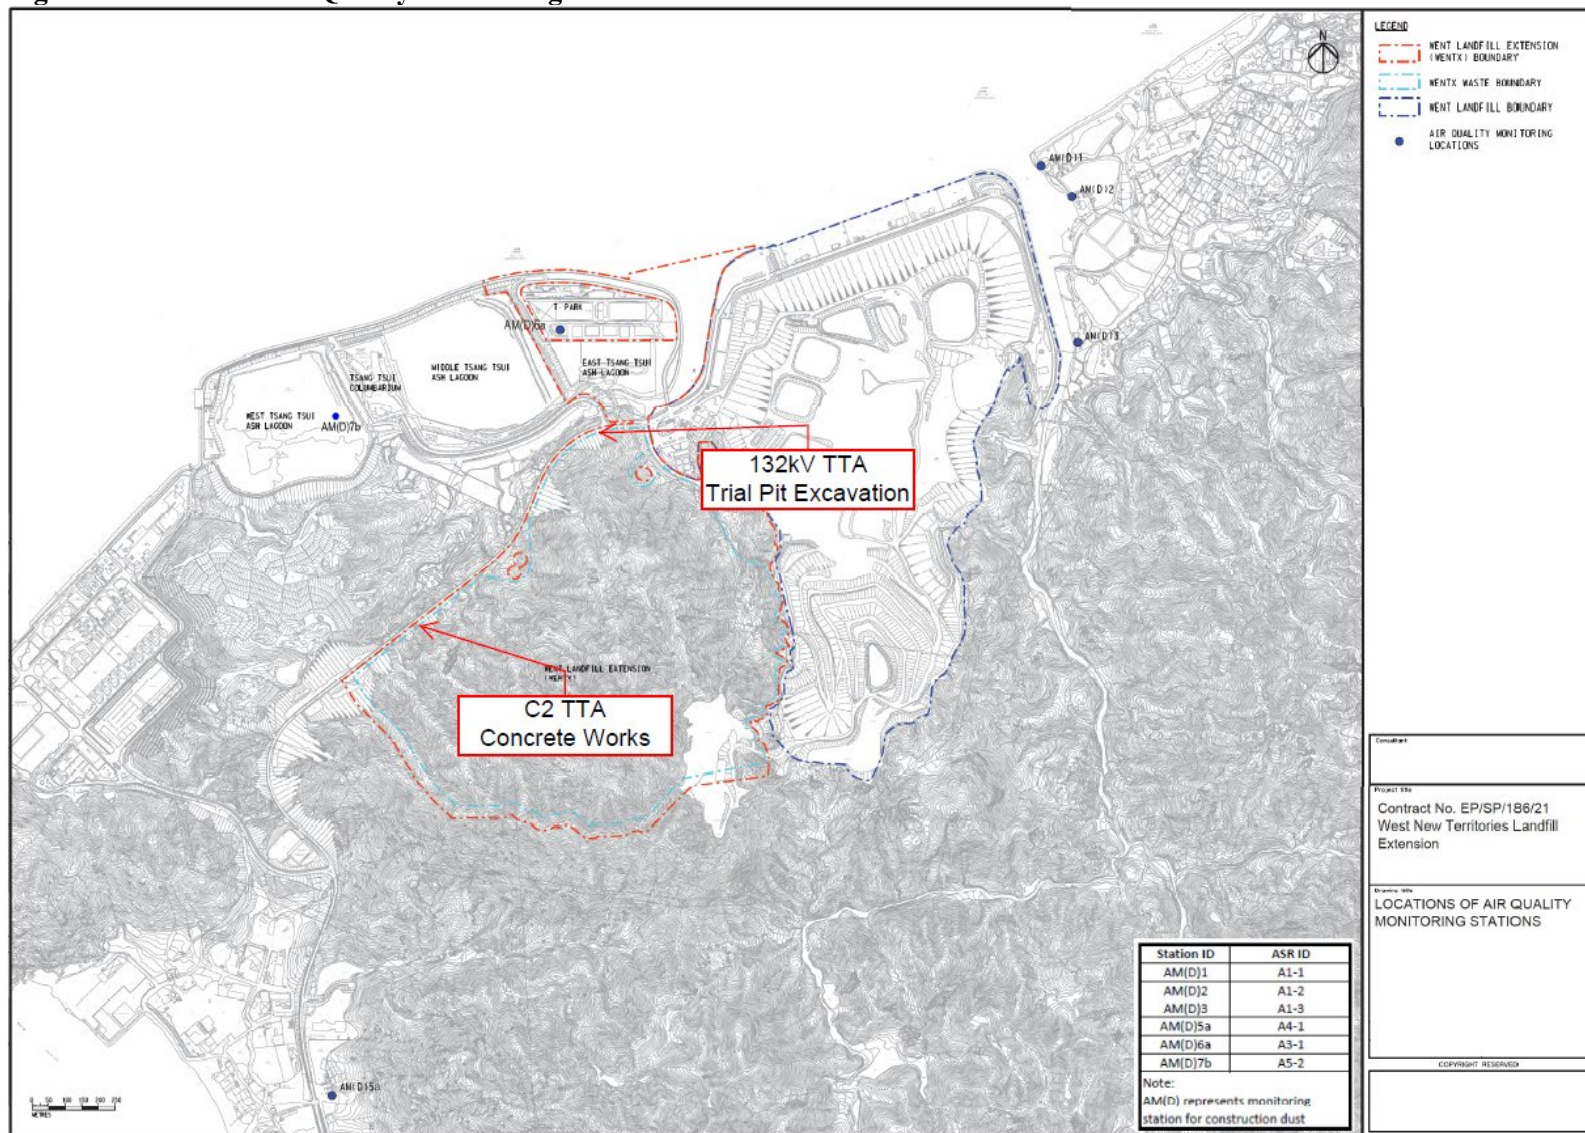


Photo Record



Photo 1

Exposed surface near Nim Wan Road and 132kV TTA was covered by tarpaulin sheets. (132kV TTA)



Photo 2

No dust emitted from the trial pit excavation works at 132kV TTA.



Photo 3

No dust emitted from the concrete works at C2 TTA.



Photo 4

Water spraying along Nim Wan Road 3 times per day.

Annex A

Table 1 Summary of 1-hour TSP Monitoring Results

1-hour TSP ($\mu\text{g}/\text{m}^3$)							
Station	Date	Start Time	1st reading	2nd reading	3rd reading	Action Level	Limit Level
AM(D)5a	29-May-26	08:55	229	254	211	371	500
	2-Jun-26	09:03	212	163	183	371	500
AM(D)6a	29-May-26	09:27	158	166	188	294	500
	2-Jun-26	09:33	131	138	144	294	500

Table 2 Summary of 24-hour TSP Monitoring Results

24-hour TSP ($\mu\text{g}/\text{m}^3$)				
Station	Date	TSP Concentration	Action Level	Limit Level
AM(D)5a	29-May-26	197	238	260
	2-Jun-26	164	238	260
AM(D)6a	29-May-26	149	159	260
	2-Jun-26	123	159	260

Appendix O

Photo Record of Tree Receptor Site of Portion B4 and 30m Tree Buffer Zone

Portion B4





30m Tree Buffer Zone








Appendix P

Photo Record of Pitcher Plant Transplantation

Portion C1 (Nursery Site)

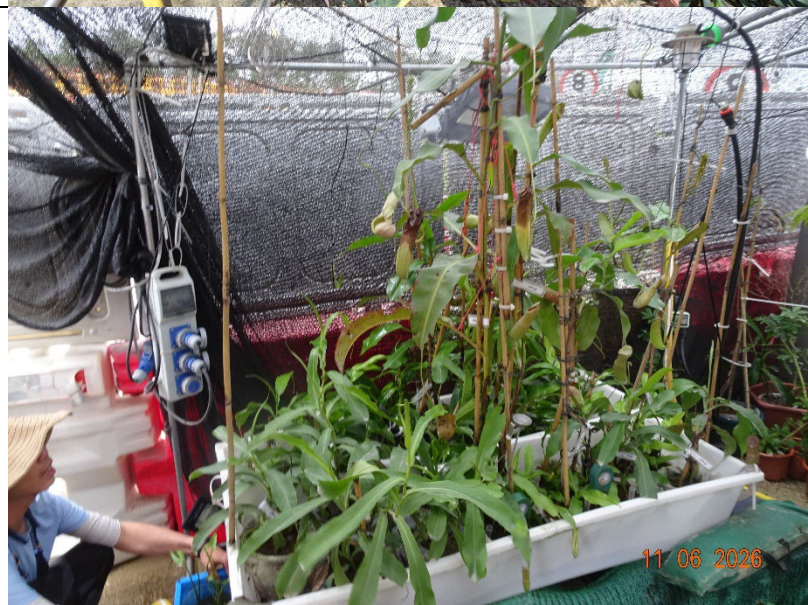

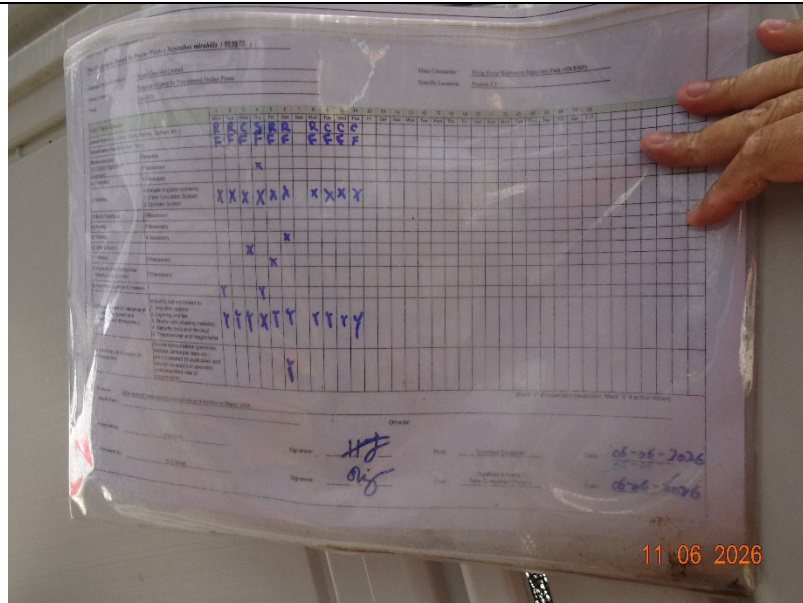

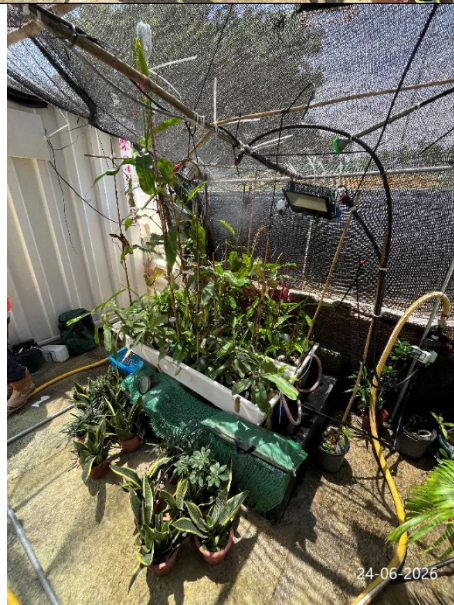

Portion C6 (Receptor Site)



Appendix Q

Environmental Review Report for Trial Operation



Environmental Protection Department
2nd floor, West Wing
Island West Transfer Station
88 Victoria Road
Kennedy Town
Hong Kong

Your reference:

Our reference: HKEPD259/50/111255

Date: 8 July 2026

Attention: Ms Kins Lo

BY EMAIL & POST
(email: wklo@epd.gov.hk)

Dear Sirs

Quotation Ref. 23-02230
Provision of Independent Environmental Checker Consultancy Services for
West New Territories Landfill Extension
Environmental Review Report for Trial Operation

We refer to emails of 30 April, 26 May, 3 June, 23 June and 6 July 2026 from Hong Kong Resources Recovery Park attaching the report of the captioned.

We have no comment and hereby verify the captioned report in accordance with Clause 1.9 of the Environmental Permit (EP No.: EP-393/2010/A) and Further Environmental Permit (FEP No.: FEP-01/393/2010/A).

Should you have any queries, please do not hesitate to contact the undersigned or our Mr Ricky Lau on 2618 2831.

Yours faithfully
ANEWR CONSULTING LIMITED

James Choi
Independent Environmental Checker

CPSJ/LCCR/phwk

Our Ref: TCS01325/23/300/L0240a

Hong Kong Resources Recovery Park
29/F China Overseas Building,
139 Hennessy Road, Hong Kong

Attn: Mr. Kenneth Lau

8 July 2026
By email

Dear Sir,

Re: Contract No. EP/SP/186/21
West New Territories (WENT) Landfill Extension
ETL's Certification letter for Environmental Review Report - Trial Operation

With reference to the Environmental Review Report for Trial Operation of WENT Landfill Extension submitted on 7 July 2026, we hereby certify this submission in accordance with Condition 1.9 of Environmental Permit EP-393/2010/A and Further Environmental Permit FEP-01/393/2010/A.

Should you have any queries or require further information, please feel free to the undersigned at Tel: 2959-6059 or Fax: 2959-6079.

Yours sincerely,
For and on Behalf of
Action-United Environmental Services & Consulting



Tam Tak Wing
Environmental Team Leader



Environmental Review Report for Trial Operation

Document No. -----

WBS No. -----

Date 6-July-2026

Check Cert. Ref. /Date

Registered Ref./Date

Document History – This document was prepared by Binnies Hong Kong Limited

Rev.	Status	Purpose of Issue Description	Date	Prepared by	Checked by	Approved by
1	Draft	Issue 1	30-Apr-2026	Steven Leung	Damon Fung	Eric Lo
2	Draft	Issue 1.1	26-May-2026	Steven Leung	Damon Fung	Eric Lo
3	Draft	Issue 1.2	29-May-2026	Steven Leung	Damon Fung	Eric Lo
4	Draft	Issue 1.3	16-June-2026	Steven Leung	Damon Fung	Eric Lo
5	Draft	Issue 1.4	6-July-2026	Steven Leung	Damon Fung	Eric Lo





TABLE OF CONTENT

1	Introduction	3
1.1	Background.....	3
1.2	Purpose and Structure of the Report	3
2	Description of Trial Operation Arrangement.....	4
2.1	Proposed Trial Operation Arrangements.....	4
2.2	Partial Operation of Landfill Infrastructure	4
2.3	Potential Environmental Implications.....	5
3	Air Quality	7
4	Odour.....	9
5	Water Quality Impact Review.....	11
6	Review of Other Environmental Impact	13
6.1	Noise	13
6.2	Waste Management Implications	13
6.3	Landfill Gas Hazard.....	13
6.4	Cultural Heritage	13
6.5	Ecology.....	13
6.6	Landscape and Visual	14
6.7	Potential Environmental Impact Associated with Pulverised Fuel Ash	14
7	Conclusion.....	15



TABLE

Table 2-1 Temporary Arrangement of Leachate Treatment Facilities	5
Table 5-1 Average Monthly Rainfall in Tap Shek Kok and Lau Fau Shan	11



1 Introduction

1.1 Background

- 1.1.1** Contract No. EP/SP/186/21 provides for the Design, the Works, the Operation and the Aftercare of the WENTX landfill Extension (WENTX – the Project), comprising the design and development of a sanitary landfill, including the site formation and phased development of the landfill; provision of landfill infrastructure and facilities for landfilling operation; provision of leachate management system; provision of LFG management system; Restoration of the landfill, aftercare of the landfill facilities for a period of 30 years following the completion of Restoration Works.
- 1.1.2** The Project is classified as a Designated Project (DP) requiring an Environmental Permit (EP) under Schedule 2, Part I of the Environmental Impact Assessment Ordinance (EIAO) (Cap. 499). The Environmental Impact Assessment (EIA) Report (AEIAR-147/2009) of WENTX was approved in November 2009 and the respective EP (EP-393/2010) was granted in June 2010.
- 1.1.3** An Enhanced Scheme with a number of design changes in the Project had been proposed and the variation of Environmental Permit (VEP-617/2022) was approved in July 2022.
- 1.1.4** Before the official full WENTX landfill operation, the WENTX is scheduled to commence a trial operation in the 2nd half of 2026, including limited waste intake to ensure a smooth transition from the existing WENT Landfill to the WENTX.

1.2 Purpose and Structure of the Report

- 1.2.1** The purpose of the Environmental Review Report (ERR) is to review, identify and evaluate the potential environmental impacts of the proposed trial operation arrangement.
- 1.2.2** This structure of the ERR is outlined as follows.
- Section 1 - Introduction
 - Section 2 – Description of Trial Operation Arrangement
 - Section 3 – Air Quality Impact Review
 - Section 4 – Odour Impact Review
 - Section 5 – Water Quality Impact Review
 - Section 6 – Review of Other Environmental Impact
 - Section 7 – Conclusion



2 Description of Trial Operation Arrangement

2.1 Proposed Trial Operation Arrangements

- 2.1.1** During the trial operation period, tentatively spanning late 2026 to Q1 2027, WENTX will begin trial operation with an initial waste reception rate of 2,000 t/d of Municipal Solid Waste (MSW) and the waste intake will be gradually increased to about 4,800 t/d of total waste subject to the actual waste intake and the landfill life of the existing WENT Landfill. Further ramp-up of waste intake will take place after the trial operation period.
- 2.1.2** The waste received at WENTX during the trial operation period will be diverted from the existing WENT as part of transition arrangement, therefore, there will be no net increase in the total quantity of waste received within both the WENTX and the existing WENT Landfill. In addition, no special waste will be received at WENTX during this period.
- 2.1.3** The proposed trial operation arrangement is a temporary operating mode under which WENTX would commence limited waste reception before full commissioning of the permanent leachate treatment works (LTW) and the permanent landfill gas management and utilisation (LFGM&U) facilities.
- 2.1.4** The temporary arrangement is tentatively proposed for the period from September 2026 to Q1 2027.

2.2 Partial Operation of Landfill Infrastructure

Leachate Treatment Works

- 2.2.1** The LTW is designed to treat raw leachate generated from WENTX Landfill. The raw leachate will be collected from various points, including the temporary leachate lagoon, in the WENTX Landfill and flown to Equalization Tank System in LTW. The treatment process can be divided into three main systems: Ammonia Stripping Plant, Membrane Bioreactor System and Membrane Filtration System.
- 2.2.2** After the flow equalization, the leachate will be treated by Ammonia Stripping Plant (ASP) for removal of ammonia before entering the Pre-screening for fibrous substances removal and Membrane Bioreactor (MBR) System for biological treatment. Carbon source will be dosed into the ASP Effluent Buffer Tanks prior to entering MBR System to adjust the favourable range of C:N ratio to assist in nitrification and denitrification processes. Organic compounds (COD/BOD) removal will be undergone with the assist of aeration process in aerobic bioreactor tanks. The biological treated leachate will then go through the Membrane Filtration System for the removal of total suspended solids (TSS), total dissolved solids (TDS), organic compounds (COD/BOD), Total Nitrogen (TN) and Pathogens/ Bacteria (E-coli) to meet the treated effluent standards.
- 2.2.3** During the proposed trial operation period, the ASP will be absence. MBR and filtration building will be in partial operation, with deodorizing unit in place. All emission sources would be enclosed and installed with air-tight covers and the foul air underneath the covers would be drawn through deodorisers with 99.2% odour removal efficiency.
- 2.2.4** The detailed temporary arrangement of the leachate treatment facility during the trial operation period is shown in **Figure 2-1** and **Table 2-1**.

Figure 2-1 Partial Operation of Leachate Treatment Plant

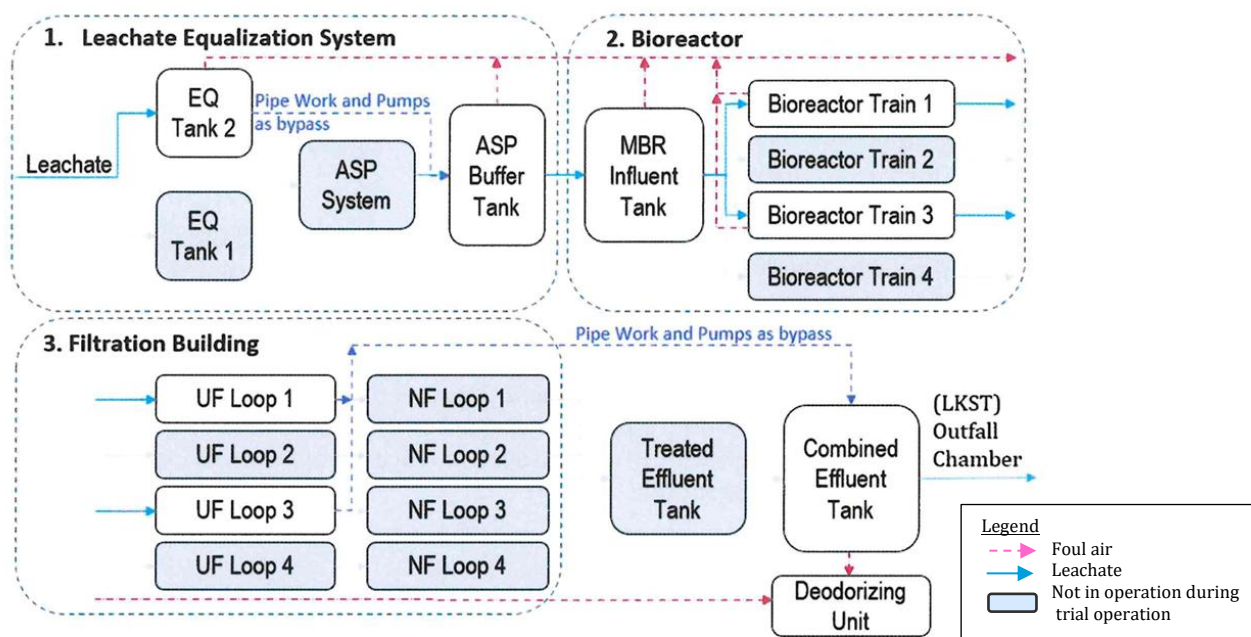


Table 2-1 Temporary Arrangement of Leachate Treatment Facilities

FACILITIES FOR LEACHATE TREATMENT	OPERATION MODE
Mobile Flare at Temporary Leachate Lagoon	Yes
Raw Leachate Storage	Partial
Ammonia Stripping Plant	No
Stripped Leachate Storage	Yes
Membrane Bioreactor	Partial
Membrane Filtration System	Partial
Deodorizer	Yes

Landfill gas management and utilisation (LFGM&U) facilities

- 2.2.5** During the trial operation period, limited quantities of municipal solid waste will be deposited at WENTX, and the waste will remain at an early stage of decomposition. Landfill gas generation is expected to be minimal under such conditions.
- 2.2.6** During the trial operation period, the (LFGM&U) facilities will be unavailable. As stated in the Landfill Gas Utilisation Plan, LFG utilisation consisting of the Ammonia Stripping Plant with thermal oxidizer for leachate treatment will be implemented in tandem with the LTW system construction completion and commencement of operation, subject to the availability of sufficient LFG.
- 2.2.7** Temporary LFG control measures, including the provision of mobile flaring together with good landfill operational practices (e.g. daily soil cover and proper waste compaction), will be implemented to manage any minor LFG emissions during the trial operation period.

2.3 Potential Environmental Implications

- 2.3.1** To facilitate the trial operation, the existing weight bridge and vehicle washing facilities at the WENT Landfill will be utilised on a temporary basis. The use of the existing WENT facilities will



not involve any modification to their design, operation, or discharge arrangements. Vehicle washing effluent will continue to be managed under the existing licensed system at WENT, and no additional wastewater discharge, odour emission, or environmental nuisance is anticipated. This temporary arrangement will cease upon commissioning of the permanent WENTX weight bridge and vehicle washing facilities prior to full operation.

- 2.3.2** The proposed trial operation is a temporary arrangement to be adopted prior to full operation of the Project, with no new construction activities or alteration of the scale or nature of the construction works. It is therefore anticipated there will be only potential environmental implications during operation stage and no adverse impact during construction stage, and the later restoration and aftercare stage.



3 Air Quality

3.1.1 The proposed trial operation that might have potential air quality impacts during the early operation phase are list below.

- Gaseous emission from landfill infrastructure
- Surface gas emission from waste tipping operation
- Dust emission from waste tipping operation

3.1.2 Based on the review of the EIA report for the Development of Integrated Waste Management Facility Phase 2 (I-Park 2) approved in December 2024, there are no new Air Sensitive Receivers (ASRs) identified within 500 m from the boundary of the Project since the approval of VEP-617/2022 during the trial operation period.

Gaseous emission from landfill infrastructure

3.1.3 According to the EIA report and the AQIA conducted under VEP-617/2022, during the operation phase the landfill infrastructure at WENTX, including the ASPs at the Leachate Treatment Plant, Flare Systems at the LFG Treatment Plant, and LFG power generators, would constitute the primary sources of gaseous air emissions. These facilities emit nitrogen dioxide (NO₂), sulphur dioxide (SO₂), particulate matter (PM₁₀/PM_{2.5}), and trace amounts of volatile organic compounds (VOCs) such as benzene and vinyl chloride as a result of controlled combustion of landfill gas.

3.1.4 During the proposed trial operation period, there will be mobile flare only to be installed at the temporary leachate lagoon, while the primary sources of gaseous air emissions including LFG Treatment Plant (mainly contributed from ASPs), Flare Systems and LFG Power Generators will be absent. It is anticipated that the overall gaseous emissions from the Project will be reduced during this temporary arrangement.

Surface gas emission from waste tipping operation

3.1.5 During the trial operation period, the waste intake and the quantity of newly deposited waste would be comparatively limited. In addition, the deposited waste would remain at an early stage of decomposition, and substantial landfill gas generation is not expected during this period. Surface gas emission from the active tipping face and newly filled waste is therefore expected to be insignificant.

3.1.6 With the implementation of good site practices and appropriate mitigation measures recommended in the approved EIA Report and VEP, including application of 150 mm thick daily soil cover, and the use of Posi-shell and/or other suitable cover materials over the active tipping face at the end of each operating day, any potential surface gas emission would be effectively controlled. No adverse residual air quality impact is anticipated during the trial operation period.


Dust emission from waste tipping operation

3.1.7 Waste tipping activities during the trial operation may give rise to limited fugitive dust emissions due to vehicle movement and waste handling. The active tipping face for trial operation will be located within Cell 1B (as illustrated in **Figure 3-1**), which is a bowl-shaped area, surrounded by existing hillside terrain and the eastern platform of the landfill. No additional waste vehicles will be generated during the trial operation, as the waste intake is diverted from the existing WENT Landfill. The overall traffic flow remains unchanged, and therefore no increase in air quality emissions arising from traffic is anticipated. As the



approved VEP-617/2022 has already assessed the worst-case operational scenario and concluded that no adverse air quality impact would arise with the implementation of mitigation measures, therefore no adverse air quality impact is anticipated from the smaller-scale waste reception arrangement. No additional air quality mitigation measures are required.

Figure 3-1 Location of Waste Tipping Area during Trial Operation

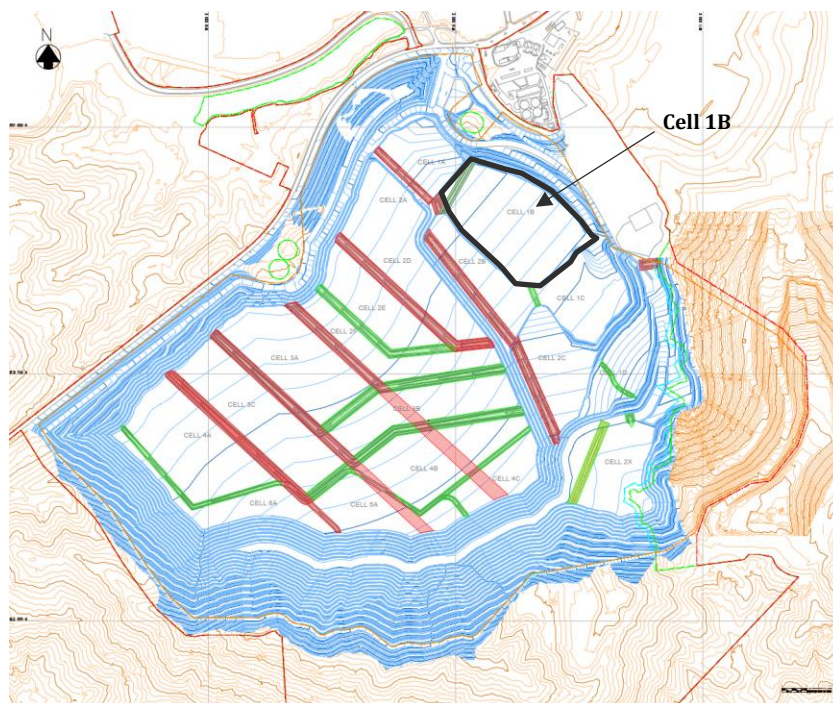

Impact from Parallel Waste Reception at WENT and WENTX

- 3.1.8** During the trial operation period, waste reception will occur in parallel at both the existing WENT Landfill and WENTX. However, the waste received at WENTX will be diverted from WENT as for trial period, and there will be no increase in the overall waste quantity handled within the two facilities. The corresponding waste intake and tipping size at WENT will be reduced which will be offset by the WENTX tipping face. As such, the total number of waste vehicles and associated traffic flow within the study area will remain unchanged, and there will be no additional vehicular emissions arising from the proposed arrangement. Therefore, no adverse cumulative air quality impact is anticipated.
- 3.1.9** As the approved VEP-617/2022 has already assessed the worst-case operational scenario at WENTX and concluded that no adverse air quality impact would arise with the implementation of mitigation measures, therefore no adverse air quality impact is anticipated from the smaller-scale waste reception arrangement.

EM&A Requirements

- 3.1.10** The Environmental Monitoring and Audit (EM&A) requirements stipulated in the approved EIA Report, Environmental Permit and VEP-617/2022 will be fully implemented. No change to the approved EM&A requirement is proposed. As the proposed trial operation serves as a temporary transitional arrangement prior to the full operation of the Project, the existing EM&A programme will continue to be implemented throughout this period.



4 Odour

4.1.1 The proposed trial operation that might have potential air quality impacts during the early operation phase are list below.

- Odour from waste tipping activities and leachate treatment facilities.

4.1.2 During the trial operation, WENTX will only receive a limited quantity of waste. The waste tipping activities will be limited in scale, and the tipping face will be relatively small. As the deposited waste will remain at an early stage of decomposition, significant odour generation is not expected. Odour emission from the active tipping face will be controlled through good site practices and mitigation measures, including the application of 150 mm thick daily soil cover, and the use of Posi-shell and/or other suitable cover materials over the active tipping face at the end of each operating day. Given the reduced scale of operation and the implementation of mitigation measures, the potential odour impact is expected to be no greater than the full operational scenario assessed under the approved VEP-617/2022, hence no adverse odour impact is anticipated from waste tipping activities during trial operation.

4.1.3 During the proposed trial operation period, the leachate will be first collected in the temporary leachate lagoon. The lagoon can provide temporary leachate storage for seasonal fluctuation and used to provide a steady flow of leachate to Leachate Treatment Plant. The temporary leachate lagoon will be enclosed with floating cover with mobile flare to destruct the odorous lagoon surface emission. The odour emission from the covered lagoon system is considered insignificant.

4.1.4 Odour sources within the Leachate Treatment Works includes ASP tanks, leachate equalization tanks, ASP effluent buffer tank, MBR influent tank, MBR trains, sludge holding tank, screw press filtrate tank, sludge skip.

4.1.5 Under trial operation period, the ASP tanks and half of the equalization tanks will be empty and not be in used. All other emission sources would be installed with air-tight covers and the foul air underneath the covers would be drawn through deodorisers with 99.2% odour removal efficiency.

4.1.6 With the installation of appropriate odour removal facilities for the leachate treatment facilities and eliminated odour emission sources during the partial operation of leachate treatment plant. It is anticipated there will be no adverse odour impact from leachate treatment facilities during the trial operation.

Impact from Parallel Waste Reception at WENT and WENTX

4.1.7 During the trial operation period, waste will be received concurrently at WENT and WENTX. However, the arrangement involves redistribution of waste rather than an increase in total waste quantity. The total quantity of waste received within WENT and WENTX will not increase and it will only be partially diverted from WENT to WENTX as for trial period. The corresponding waste intake and tipping size at WENT will be reduced, which will be offset by the WENTX tipping face. As described in **Section 4.1.2**, the scale of tipping activities at WENTX will be limited, and the tipping face will be relatively small. As the deposited waste will remain at an early stage of decomposition, significant odour generation is not expected at WENTX during the trial operation period. Furthermore, good site practices and mitigation measures will be implemented at both sites to control odour emission. Therefore, no adverse cumulative odour impact is anticipated.



EM&A Requirements

- 4.1.8** The Environmental Monitoring and Audit (EM&A) requirements stipulated in the approved EIA Report, Environmental Permit and VEP-617/2022 will be fully implemented. No change to the approved EM&A requirement is proposed. As the proposed trial operation serves as a temporary transitional arrangement prior to the full operation of the Project, the existing EM&A programme will continue to be implemented throughout this period.



5 Water Quality Impact Review

5.1.1 The proposed trial operation that might have potential water quality impacts during the early operation phase are list below.

- Water quality impact from leachate treatment facilities

5.1.2 Under the approved EIA report, the leachate generated from the landfill site in different year is calculated by:

$$\text{Leachate generation} = \text{runoff coeff.} \times \text{operation area} \times \text{effective rainfall}$$

5.1.3 The approved EIA reviewed rainfall data from Tap Shek Kok and Lau Fau Shan, adopted the Tap Shek Kok annual rainfall of 1813.5 mm (average daily rainfall of 5.0 mm) on a conservative basis, and further noted that effective rainfall was about 902 mm/year, such that the leachate estimation based on average rainfall is on the high side.

5.1.4 The approved EIA Table 5.8d indicates that, for the reference phasing plan, the estimated leachate generation in the first year with waste intake (Year 1) is 596 m³/day, the estimated amount of leachate generated is relatively small compared to the estimated maximum is 1,789 m³/day in Year 12.

5.1.5 Under the approved VEP-617/2022, the latest development footprint of WENTX has been shrank and further reduce the working area and hence the leachate generation.

5.1.6 The tentative trial operation period is from Sep 2026 to Q1 2027, rainfall data from Hong Kong Observatory Rain Gauge at Tap Shek Kok and Lau Fau Shan between 1996 to 2025 had been reviewed, the average daily rainfall during September to Mar is estimated to be 2.1mm, much lower than the adopted rainfall in the approved EIA report.

Table 5-1 Average Monthly Rainfall in Tap Shek Kok and Lau Fau Shan

MONTH	AVERAGE MONTHLY RAINFALL IN TAP SHEK KOK (MM)	AVERAGE MONTHLY RAINFALL IN LAU FAU SHAN (MM)
Jan	30.7	29.9
Feb	39.6	36.4
Mar	62.9	55.6
Apr	127.4	110.9
May	245.7	209.6
Jun	346.6	313.9
Jul	237.1	227.4
Aug	323.5	279.3
Sep	214.4	191.2
Oct	46.4	67.4
Nov	31.5	33.8
Dec	25.6	25.1
Daily Average (Jan – Dec)	4.7	4.3
Daily Average (Sep – Mar)	2.1	2.1



- 5.1.7** It is anticipated that the leachate generation during the trial operation will be much lower than the peak leachate generation of the landfill development. It is confirmed by the WENTX operator the design capacity of the partial operation of leachate treatment plant can meet the treatment demand during this period. The operator also confirms that the partial operation of LTW is able to meet the WENT discharge license requirement.
- 5.1.8** To conclude, it is confirmed by the operator that the partial operation of leachate treatment plant can cope with the relatively small amount of the landfill generated leachate and meet the WENT discharge license requirement. The performance of leachate treatment plant will be monitored and comply with the requirement of the statutory WPCO license. It is anticipated there will be no adverse water quality impact during trial operation.

Impact from Parallel Waste Reception at WENT and WENTX

- 5.1.9** During the trial operation period, leachate will be generated at both WENT and WENTX under the temporary parallel waste reception arrangement. As discussed above, the leachate generated at WENTX during trial operation is expected to be relatively small, given the limited waste intake and lower rainfall during the trial period. Both sites will continue to operate the leachate management system in accordance with the existing discharge license requirements. Therefore, no adverse cumulative water quality impact is anticipated.

EM&A Requirements

- 5.1.10** The Environmental Monitoring and Audit (EM&A) requirements stipulated in the approved EIA Report, Environmental Permit and VEP-617/2022 will be fully implemented. No change to the approved EM&A requirement is proposed. As the proposed trial operation serves as a temporary transitional arrangement prior to the full operation of the Project, the existing EM&A programme will continue to be implemented throughout this period.



6 Review of Other Environmental Impact

6.1 Noise

- 6.1.1** In the partial operation of landfill infrastructure in the trial operation period, the numbers of fixed noise source will be reduced. There is no new NSR identified within 300 m from the boundary of the Project since the approval of VEP-617/2022 during the trial operation period and the NSRs are located at least 1 km away from the nearest worksites and landfill cells. The operation hours during the trial operation period will remain the same as those assessed under the approved VEP-617/2022, i.e. from 08:00 to 20:00. An existing Construction Noise Permit (CNP) has been obtained for the night-time works for WENTX and the trial operation arrangement will continue to comply with the relevant CNP requirements and corresponding mitigation measures. Taking into account the unchanged operation hours, reduced fixed noise source and the unchanged separation distance to NSRs, no adverse operational noise impact is anticipated during the trial operation period with the implementation of mitigation measures.

6.2 Waste Management Implications

- 6.2.1** The proposed arrangement would not change the operational activities identified in the EIA report and under VEP-617/2022. There would be no changes to the types, scale, management and disposal methods for the identified wastes as presented in the EIA report, therefore, no adverse waste management implications would arise from the proposed change with proper implementation of the recommended waste management measures in the EIA report.

6.3 Landfill Gas Hazard

- 6.3.1** As discussed in Sections 2.2.4 and 2.2.6, the waste intake at WENTX during the trial operation period will be limited and the deposited waste will remain at an early stage of decomposition. Good landfill practices such as proper waste compaction and daily cover will also be maintained. As such, landfill gas generation is expected to be negligible during the trial operation period. According to the Detailed Landfill Gas Hazard Assessment Report under EP Condition 2.9, the overall risk within the Project is anticipated the same whereas no risk is anticipated outside the Project. The LFG generation at the early phase of landfill operation would be negligible and would not pose unacceptable risk. The respective cut-off trench section for each landfill cell will be constructed in accordance with landfill development phasing plan and should be completed prior to the onset of such landfill gas generation. Monitoring wells have been constructed and would be in operation for monitoring. In view of the mitigation measures in place and minimal LFG generation during trial operation period, no adverse landfill gas hazard impact is anticipated.

6.4 Cultural Heritage

- 6.4.1** With no change of waste boundary compared to the Enhanced Scheme proposed under VEP-617/2022, it is anticipated there will be no adverse impact on cultural heritage due to the proposed arrangement.

6.5 Ecology

- 6.5.1** With no change of works boundary compared to the Enhanced Scheme proposed under VEP-617/2022, it is anticipated there will be no additional loss of habitat and no adverse impact due to the proposed arrangement.



6.6 Landscape and Visual

- 6.6.1** As the proposed design changes would remain in the designated operational area as assessed in the EIA report and VEP, there is no change to the works boundary and landscape setting compared to the Enhanced Scheme proposed under VEP-617/2022. As described in Section 3.1.7, the waste tipping activities will be confined to Cell 1B which is located within a bowl-shaped area, surrounded by hillside terrain and eastern platform. In addition, the active tipping face during trial operation will be relatively small in scale. A 30 m tall earth bund will be provided as mitigation measures. Together with the practice of filling waste at the low elevation of the landfill cell, it is anticipated there will be no adverse landscape and visual impact due to the proposed arrangement.

6.7 Potential Environmental Impact Associated with Pulverised Fuel Ash

- 6.7.1** The west and middle Tsang Tsui Ash Lagoons (TTALs) have been decommissioned in accordance with EP nos. EP-652/2024 and EP-618/2022 and have been excluded from the waste filling area under VEP 617/2022. The health risk induced by radon emissions associated with pulverized fuel ash at the west and middle Tsang Tsui Ash Lagoons (TTALs) is considered insignificant.

6.8 EM&A Requirements

- 6.8.1** The Environmental Monitoring and Audit (EM&A) requirements stipulated in the approved EIA Report, Environmental Permit and VEP-617/2022 will be fully implemented. No change to the approved EM&A requirement is proposed. As the proposed trial operation serves as a temporary transitional arrangement prior to the full operation of the Project, the existing EM&A programme will continue to be implemented throughout this period.
- 6.8.2** The established baseline monitoring programme, including LFG and groundwater monitoring, will be continued at the same frequencies during the trial operation period in accordance with the requirements set out in the approved EM&A Manual and EP conditions. The monitoring results collected during trial operation will also be incorporated into the regular EM&A report and baseline monitoring report in order to verify and keep track on the environmental performance of the Project.



7 Conclusion

- 7.1.1** An environmental review has been conducted for the proposed trial operation. In view of the nature and scope of the infrastructures, the potential impacts associated with the trial operation would be occurred during the operation phase only. The potential issues due to the proposed arrangement have been assessed. By implementing the appropriate mitigation measures suggested in the approved EIA report and VEP, the potential environmental impacts arising from the proposed changes to the sensitive receivers are considered insignificant.
- 7.1.2** No additional environmental monitoring is required and regular EM&A requirements as specified in the Environmental Monitoring and Audit (EM&A) Manual would be followed.

END OF TEXT