





Website: www.acuityhk.com



Unit C, 11/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon.

C

Tel. : (852) 2698 6833 Fax.: (852) 2698 9383

Contract No. AL G513

Expansion of Wo Hop Shek Crematorium

Monthly EM&A Report No.15 (Period from 01 May to 31 May 2021)

Document No.

ASCL	/	2018028	/	0015	/	A
Publisher		Project Code		Sequential No.		Revision
						Index

	Prepared by:	Reviewed by:	Certified by:
Name	Philip CHAN	Nelson TSUI	Kevin LI
Position	Environmental Team Member	Environmental Team Member	Environmental Team Leader
Signature	Philip	That	K;
Date:	07/06/2021	07/06/2021	07/06/2021



REVISION HISTORY

REV.	DESCRIPTION OF MODIFICATION	DATE
A	First Issue for Comments	07 JUN 2021



CONTENTS

Executive Sum	mary1
1. Basic Proj	ect Information3
2. Monitorir	ng Results8
3. Waste	13
	of Monitoring Exceedance, Complaints, Notification of Summons and Prosecutions
	e Inspection
	y Issues
Appendix A	Master Programme
Appendix B	Work Area for the Contract No. AL G513
Appendix C	Summary of Implementation Status of Environmental Mitigation
Appendix D	Impact Monitoring Schedule of the Reporting Month
Appendix E	Event/Action Plan for Dust Exceedance
Appendix F	Dust Monitoring Equipment Calibration Certificate
Appendix G	The Certification of Laboratory with HOKLAS Accredited Analytical Tests
Appendix H	Location Plan of Air Quality Monitoring Station
Appendix I	Dust Monitoring Data
Appendix J	Waste Flow Table
Appendix K	Site Inspection Proforma
Appendix L	Statistics on Complaint, Notifications of Summons and Successful Prosecutions
Appendix M	Impact Monitoring Schedule of Next Reporting Month
Appendix N	Transportation Routes to/from the site
Appendix O	Lab Report



EXECUTIVE SUMMARY

INTRODUCTION

- A1. The Project, Expansion of Wo Hop Shek Crematorium, is a Designated Project under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO) and is currently governed by a Environmental Permit (EP No. EP 329/2009) for the construction and operation of the Project.
- A2. In accordance with the Environmental Monitoring and Audit (EM&A) Manual for the Project, EM&A works for air quality monitoring and waste management should be carried out by Environmental Team (ET), Acuity Sustainability Consulting Limited (ASCL), during the construction phase of the Project.
- A3. This is the 15th Monthly EM&A Report, prepared by ASCL, for the Project summarizing the monitoring results and audit findings of the EM&A programme at and around Wo Hop Shek Crematorium during the reporting period from 01 May 2021 to 31 May 2021.
- A4. The EM&A programme for this contract has covered environmental monitoring on construction dust level at selected NSRs and Contractor's environmental performance auditing in the aspects of construction dust, construction noise, water quality, waste management, Landscape and Visual and Ecology.

SUMMARY OF MAIN WORKS UNDERTAKEN & KEY MITIGATION MEASURES IMPLEMENTED

- A5. Key activities carried out in this reporting period for the Project included the following:
 - Superstructure
- A6. The major environmental impacts brought by the above construction works include:
 - Construction noise generation from construction works to superstructure
 - Wastewater generation from superstructure
 - Waste generation from construction activities
- A7. The key environmental mitigation measures implemented for the Project in this reporting period associated with the above construction works include:
 - Reduction of noise from equipment and machinery on-site
 - Treatment of wastewater from superstructure through sedimentation tank
 - Sorting and storage of general refuse and construction waste



SUMMARY OF EXCEEDANCE & INVESTIGATION & FOLLOW-UP

- A8. No project-related exceedance in air quality monitoring, including 24-hour TSP and 1-hour TSP of the Action Level was recorded during the reporting period.
- A9. Weekly site inspections of the construction work by ET were carried out on 05, 12, 18 and 26 May 2021 to audit the mitigation measures implementation status. Observations were recorded in the site inspection checklists and provided to the contractors together with the appropriate follow-up actions where necessary.

COMPLAINT HANDLING AND PROSECUTION

- A10.No project-related environmental complaint was received during the reporting period.
- A11. Neither notifications of summons nor prosecution was received for the Project.

REPORTING CHANGE

A12. There was no change to be reported that may affect the on-going EM&A programme.

SUMMARY OF UPCOMING KEY ISSUES AND KEY MITIGATION MEASURES

- A13.Key activities anticipated in the next reporting period for the Project will include the following:
 - Fitting out

A14. The major environmental impacts brought by the above construction works will include:

- Construction noise generation from fitting out
- Wastewater generation from fitting out
- Waste generation from construction activities
- A15. The key environmental mitigation measures for the Project in the coming reporting period associated with the above construction works will include:
 - Reduction of noise from equipment and machinery on-site
 - Treatment of wastewater from fitting out through sedimentation tank
 - Sorting and storage of general refuse and construction waste



1. Basic Project Information

1.1. BACKGROUND

The Food and Environmental Hygiene Department (FEHD) is responsible for the operation of public crematorium in Hong Kong including the Cremators at Wo Hop Shek Crematorium pursuant to Environmental Permit No. EP-329/2009. The existing Wo Hop Shek Crematorium (WHSC) was re-provisioned in February 2013. It comprises six body cremators, one bone cremator and three service halls. At the design stage, areas had already been reserved for the addition of two body cremators and one service hall. In order to cope with increasing demand for cremation sessions, Expansion of Wo Hop Shek Crematorium (the Project) is being taken forward in this juncture. This Project shall provide two new cremators at WHSC and one service hall for commissioning. Architectural Services Department (ArchSD) acts as the works agent for FEHD, is responsible for the project management of the project.

The Project consists of three construction phases. Phase I of the project was substantially completed in October 2012 while Phase II of the project was substantially completed in November 2013. The Project has been re-initiated as Phase III and Shing Hing Construction Co. Ltd. (the Contractor) has been awarded the construction contract for the Project with contract no. AL G513.

The scope of the Project comprises provision of:

- Two new body cremators;
- One new multi-purpose service hall;
- A full range of ancillary facilities; and
- Addition, alteration and modification works that are necessary for the additional cremators and service hall.


1.2. THE REPORTING SCOPE

This is the 15th Monthly EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 01 May to 31 May 2021.

1.3. PROJECT ORGANIZATION

The Project Organization structure for Construction Phase is presented in Figure 1.1.



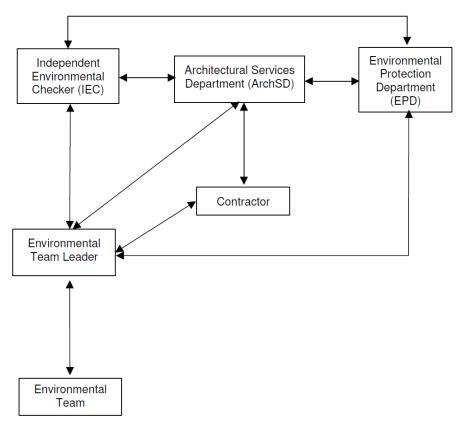

← ► Line of Communication

Figure 1.1 Project Organization Chart

Contact details of the key personnel are presented in Table 1.1 below:

Table 1.1 Contact Details of Key Personnel

Party	Position	Name	Telephone no.
Shing Hing Construction Co Ltd	Site Agent	M.Y. Wong	2807-4665
Acuity Sustainability Consulting Limited	Environmental Team Leader	Kevin Li	2698-6833
Ove Arup & Partners Hong Kong Ltd	Independent Environmental Checker (IEC)	Sam Tsoi	2528-3031



1.4. SUMMARY OF CONSTRUCTION WORKS

Details of the major construction activities undertaken in this reporting period are shown in Table 1.2 below. The construction programme is presented in **Appendix A**.

Table 1.2 Summary of the Construction Activities Undertaken during the Reporting Month

Reporting Month	Construction Activities
May 2021	1. Superstructure

1.5. SUMMARY OF ENVIRONMENTAL STATUS

Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-329/2009) as of the reporting period for the Project are summarised in Table 1.3.

Table 1.3 Summary of Status of Required Submission for EP-329/2009 for the Project

EP/FEP Condition (EP-457/2013/C)	Submission	Submission date
Condition 1.12	Notification of Commencement Date of Construction of the Project	14 Mar 2020
Condition 2.3	Inception Report	13 Mar 2019
Condition 2.4	Tree Transplant Proposal	12 Apr 2019
Condition 2.5	Landscape Plan with Tree Preservation Proposal	14 Feb 2018
Condition 5.2a	Baseline Monitoring Report	21 Jan 2020
Condition 5.2b	Alternative Air Quality Monitoring Station	05 Oct 2019



EP/FEP Condition (EP-457/2013/C)	Submission	Submission date
Condition 5.4	Monthly EM&A Report (May 2021)	11 Jun 2021

A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.4.

Table 1.4 Summary of the Status of Valid Environmental Licence, Notification, Permit and Documentations

Permit/ Licences/ Notification	Reference	Validity Period	Remarks
Environmental Permit	EP-329/2009	Throughout the Contract	-
Notification of Construction Works under the Air Pollution Control (Construction Dust) Regulation (Form NA)	Ref. Number: 455614	Throughout the Contract	-
Wastewater Discharge Licence	WT00034798-2019	10 Oct 2020 – 31 Oct 2024	-
Chemical Waste Producer Registration	5213-632-S4245-01	Throughout the Contract	-
Construction Noise Permit (24 hours) (Renewal)	GW-RN0888-20	13 Jan 2021 – 12 July 2021	-
Billing Account for Disposal of Construction Waste	7032841	Throughout the Contract	-

The status for all environmental aspects is presented in Table 1.5.

Table 1.5 Summary of Status for Key Environmental Aspects under the Updated EM&A Manual



Parameters	Status
Dust	
Baseline Monitoring	The baseline dust monitoring result has been reported in Baseline Monitoring Report and submitted to EPD under EP Condition 5.2a.
Impact Monitoring	On-going
Waste Management	
Mitigation Measures in Waste Monitoring Plan	On-going
Environmental Audit	
Site Inspection covering Measures of Air Quality, Noise Impact, Water Quality, Waste, Ecological Quality, Landscape and Visual	On-going

Other than the EM&A work by ET, environmental briefings, trainings and regular environmental management meetings were conducted, in order to enhance environmental awareness and closely monitor the environmental performance of the contractors.

The EM&A programme has been implemented in accordance with the recommendations presented in the approved EIA Report and the Updated EM&A Manual. A summary of implementation status of the environmental mitigation measures for the construction phase of the Project during the reporting period is provided in **Appendix C**.



2. Monitoring Results

2.1. MONITORING PARAMETERS

The impact monitoring had been carried out in accordance with section 2.6 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.

The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.

General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

2.2. Monitoring Equipment

1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).

The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificate of dust monitoring equipment is attached in **Appendix F**.

A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 2.1. The TSP monitoring was conducted as per the schedule presented in **Appendix D**.

The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 2.1

 Table 2.1
 Construction Dust Monitoring Equipment

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1-hour TSP	LD-5R Digital Dust Indicator	761173	5 Jul 2020
1-hour TSP	LD-5R Digital Dust Indicator	761174	5 Jul 2020
24 hour TCD	TE-5170X High Volume Sampler	1049	05 & 17 May 2021
24-hour TSP	TE-5170X High Volume Sampler	1050	05 & 17 May 2021



TE-5025A Calibration Kit 3465 23 Sep 2020

2.3. MONITORING METHODOLOGY AND QA/QC RESULTS

The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.

The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- The HVS was set at the monitoring location, with electricity supply connected and secured;
- HVS was calibrated before commencing the 1st measurement;
- The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to **Appendix G**;
- The airflow over time during sampling process was recorded by the HVS.

HVSs was free- standing with no obstruction. The following criteria were considered in the installation of the HVS:

- Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- No furnace or incinerator flues was nearby;
- Airflow around the sampler was unrestricted; and
- Permission could be obtained to set up the samplers and gain access to the monitoring station.

Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and



• Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- The filter holder and area surrounding the filter were cleaned;
- The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- A new flow rate record sheet was inserted into the flow recorder;
- The flow rates of the HVS was checked and adjusted to between 1.13-1.19 m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6- 1.7 m³min⁻¹);
- The programmable timer was set for a sampling period of 24 hours ±hour, and the starting time, weather condition and filter number were recorded;
- The initial elapsed time was recorded;
- At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

Maintenance and Calibration

- The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried



out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in **Appendix F**.

Wind Data Monitoring

• The wind speed has been recorded from Hong Kong Observatory- Tai Po Kau meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO.

2.4. MONITORING LOCATIONS

Due to the disagreement of occupants in establishment of air quality monitoring station at their private permits, both of the original proposed dust monitoring locations were rejected. Two alternative air monitoring stations Fung Kai Liu Yun Sum Memorial School and Fanling Government School had been proposed by ET and approved by IEC. Two designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 2.2. The location plan of air quality monitoring stations is shown in **Appendix H**.

Table 2.2 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
A10	Fung Kai Liu Yun Sum Memorial School
A20	Fanling Government School

2.5. MONITORING DATE, TIME, FREQUENCY AND DURATION

A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 2.3.

Table 2.3 Summary of Impact Monitoring Programme

Impact Monitoring	Duration	Duration Sampling Parameter	
Dust	1-hour continuous measurement	1 1-hour TSP	
Dust	24-hour continuous sampling	24-hour TSP	Once per six days



2.6. RESULT SUMMARY

According to our field observations, the major dust source identified at the designated air quality monitoring station in the reporting month are summarised in Table 2.4.

Table 2.4 Observation at Dust Monitoring Station

Monitoring Station	Major Dust Source
A10	Nearby traffic
A20	Nearby traffic

Air quality impact monitoring for the reporting month was carried out 05, 11, 17, 22 and 27 May 2021 at A10 and A20.

The results for 1-hour TSP and 24-hour TSP are summarized in Table 2.5 and Table 2.6. The measurement data and details of influencing factors such as weather conditions and site observation are presented in **Appendix I**.

Table 2.5 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(μg/m³)	Action Level(μg/m³)	Limit Level(μg/m³)
A10	47 - 59	290	500
A20	45 - 58	291	500

Table 2.6 Summary of 24-hour TSP Monitoring Results

Monitoring Location	g Range(μg/r	n³) Action Level(μg/m	Limit Level(μg/m³)
A10	16 - 63	169	260
A20	10 - 53	167	260



3. WASTE

3.1. WASTE RECORD OF REPORTING MONTH

The waste generated from this Project includes inert construction and demolition (C&D) materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.1. Details of cumulative waste management data are presented as a waste flow table in **Appendix J.**

Table 3.1 Quantities of Waste Generated from the Project during May 2021

	Actual Quantities of Inert C&D Materials Generated Monthly			Actual Quantities of C&D Wastes Generated Monthly							
Reporting Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics (see Note)	Chemical Waste	Others, e.g. general refuse
	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)
May 2021	8.30	0	0	0	0	0	0	0	0	0	8.30

Notes:

(1) Plastics refer to plastic bottles / containers, plastic sheets / foam from packaging material



3.2. MITIGATION MEASURES TO WASTE PRODUCTION

Mitigation measures adopted for reducing waste production are summarized in Table 3.2.

Table 3.2 Mitigation measures adopted for waste reduction

	Table 5.2 Mitigation measures adopted for waste reduction		
Types of Waste	Mitigation Measures		
Non-inert C&D Wastes	1. On-site segregation was adopted to wastes to enhance the reuse and recycling of non-inert C&D wastes. Separated containers are provided for temporary storage of different types of non-inert wastes, including the deployment of three-colour recycle bins for paper, aluminium cans, and plastic bottle recycling. Three-colour recycle bins Enclosed rubbish bin for general waste Skip for non-inert C&D waste 2. Careful design and planning with good site management to minimize over ordering and generation of waste materials.		



Types of Waste	Mitigation Measures		
Types of Waste	3. Reuse non-inert C&D materials when possible to reduce the amount of C&D waste. The timber for formwork was reused onsite. Timber for formwork was reused on-site		
	Excavated inert C&D materials were separately stored for subsequent backfilling, approximately 614 tonnes of excavated inert materials were stored in construction material storage area with coverage of impervious sheeting for on-site backfilling.		
Inert C&D Wastes			
	No excavated material was stored at material storage area in the reporting month.		
	2. Surplus excavated materials were delivered to public fill reception facilities.		
Chemical Wastes	Unused chemicals or chemicals with remaining functional capacity were reused as far as practicable.		



Types of Waste	Mitigation Measures
	Chemical with remaining functional capacity was stored in a designated area and reused on-site.

4. Summary of Monitoring Exceedance, Complaints, Notification of Summons and Prosecutions

The Environmental Complaint Handling Procedure is shown in below Figure 4.1:



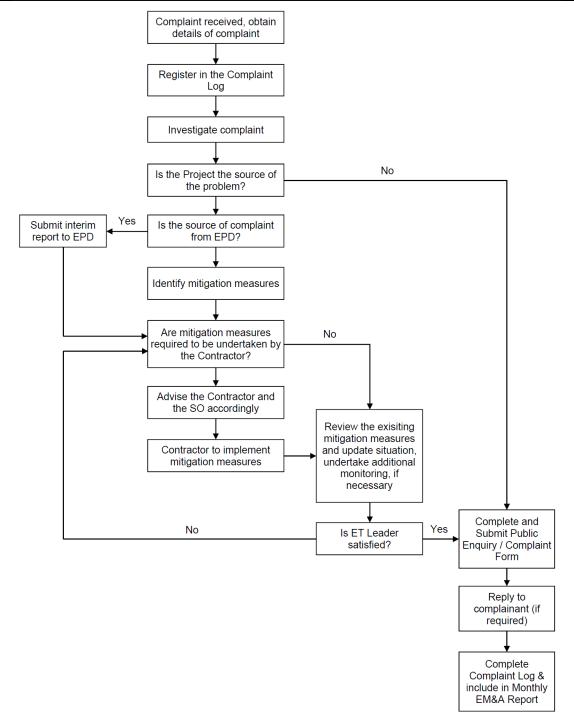


Figure 4.1 Environmental Complaint Handling Procedures

Air quality monitoring was conducted in the reporting period and no project-related exceedance of the Action Level was recorded during the reporting period.

No notification of summons and prosecution was received in the reporting period.

Statistics on complaints and regulatory compliance are summarized in **Appendix L**.



5. EM&A SITE INSPECTION

Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, site inspections were carried out on 05, 12, 18 and 26 May 2021 at the site portions list in Table 5.1 below.

Table 5.1 Summaries of Site Inspection Record

Date	Inspected Site Portion	Time
05 May 2021	Wo Hop Shek Crematorium	10:15 - 10:30 AM
12 May 2021	Wo Hop Shek Crematorium	10:00 - 10:30 AM
18 May 2021	Wo Hop Shek Crematorium	10:15 - 10:30 AM
26 May 2021	Wo Hop Shek Crematorium	10:00 – 10:15 AM

Environmental deficiencies were observed during weekly site inspection. Key observations during the site inspections and during the reporting period are summarized in **Table 5.2**.

According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in **Appendix C**.

According to the Environmental Permit (EP) clause 3.6, route 2 and route 5 shall not be used as transportation routes during construction, which was attached in **Appendix N**. The measures implemented to comply with the EP's requirement are listed as follows:

- 1. Induction training including the proper transportation routes use
- 2. Posting extracts of the transportation route to/from the site outside the entrance
- 3. Toolbox training provided to the drivers entering the site

Measure no.2 of the above was observed during the site inspections.

In order to comply with the requirement of the EP clause 3.5, the implementation of all landscaping and visual mitigation measures in accordance with the landscape plan approved was audited in the reporting period. The detailed status of the implementation is provided in the section 5 in **Appendix K** of each site inspection.

Bi-weekly checking for the transplanted tree was conducted during the site inspections. No major observation was found related to the landscaping and visual.

Site inspection proforma of the reporting period is provided in ${\bf Appendix}\;{\bf K}$



Table 5.2 Site Observations

Date	Environmental Observations	Follow-up Status
05 May 2021	Observation(s)	N:1
(Site inspection)	1. No major observation was observed.	Nil.
12 May 2021	Observation(s)	AVII.
(Site inspection)	1. No major observation was observed.	Nil.
18 May 2021	Observation(s)	Avel
(Site inspection)	1. No major observation was observed.	Nil.
26 May2021	Observation(s)	Nil.
(Site inspection)	1. No major observation was observed.	



6. FUTURE KEY ISSUES

Works to be undertaken in the next reporting month are:

Fitting out

The major environmental impacts brought by the above construction works will include:

- Construction noise generation from fitting out
- Wastewater generation from fitting out
- Waste generation from construction activities

The key environmental mitigation measures for the Project in the coming reporting period associated with the above construction works will include:

- Reduction of noise from equipment and machinery on-site
- Treatment of wastewater from fitting out through sedimentation tank
- Sorting and storage of general refuse and construction waste

The impact monitoring schedule for the next reporting month to be shown at **Appendix M**.



7. CONCLUSIONS AND RECOMMENDATIONS

This is the 15^{th} Monthly EM&A Report for the Project which summarizes the key findings of the EM&A programme during the reporting period from 01 May to 31 May 2021., in accordance with the EM&A Manual and the requirement under EP – 329/2009.

Air quality monitoring was conducted in the reporting period and no project-related exceedance of the Action Level was recorded during the reporting period.

Weekly environmental site inspection was conducted during the reporting period. Some observations were observed during site inspection and rectifications had been accomplished by contractor within a week after site inspection. The environmental performance of the project was therefore considered satisfactory.

No environmental complaint was received in the reporting period.


No notification of summons or prosecution was received since commencement of the Contract.

The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.




APPENDIX A: MASTER PROGRAMME




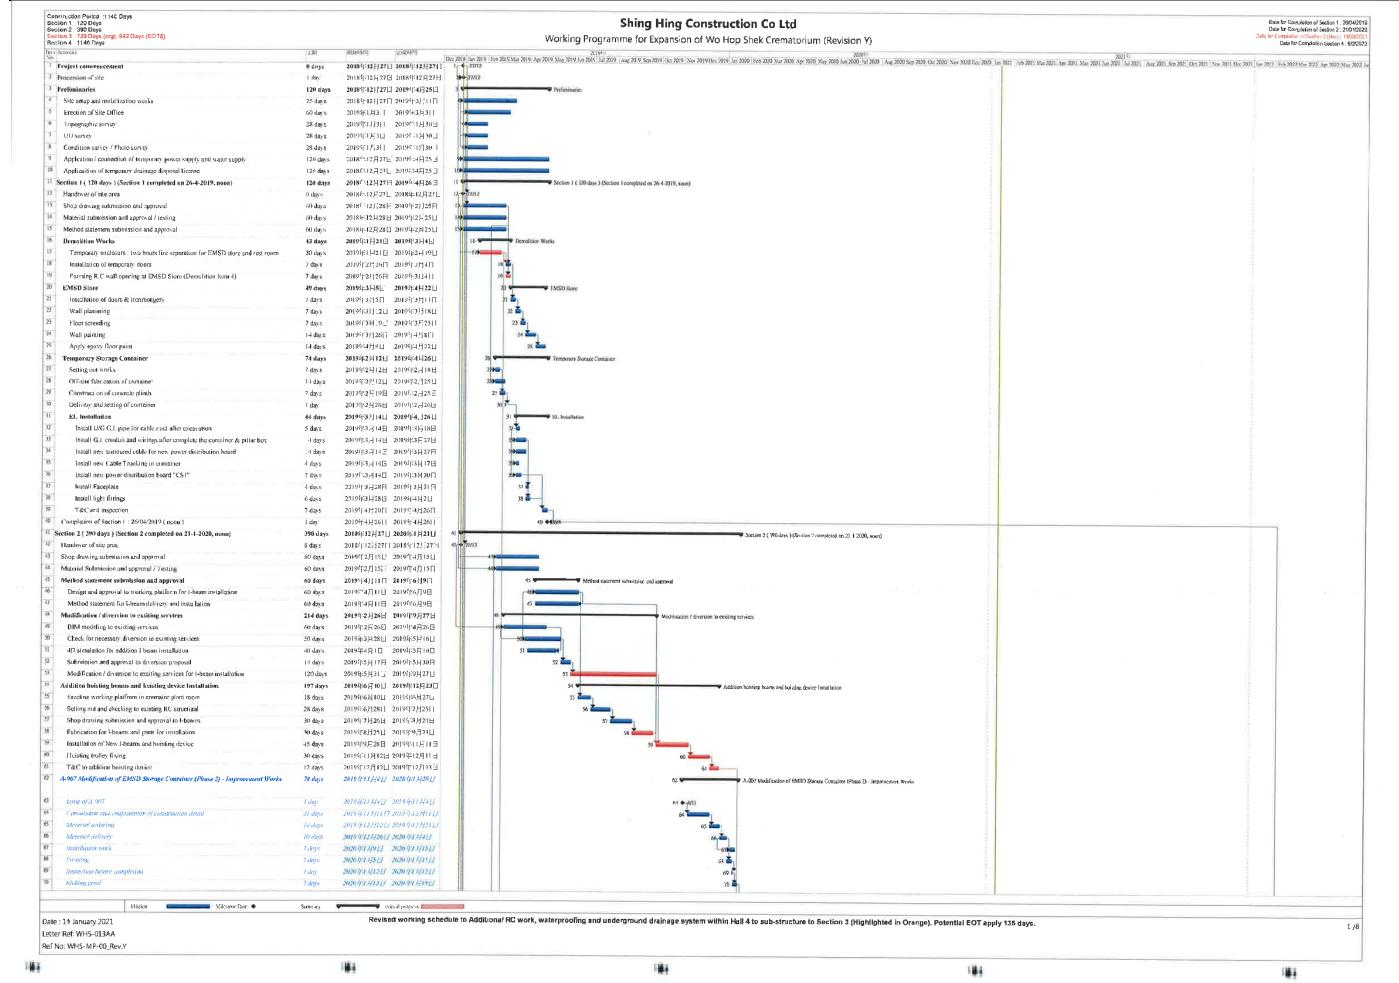




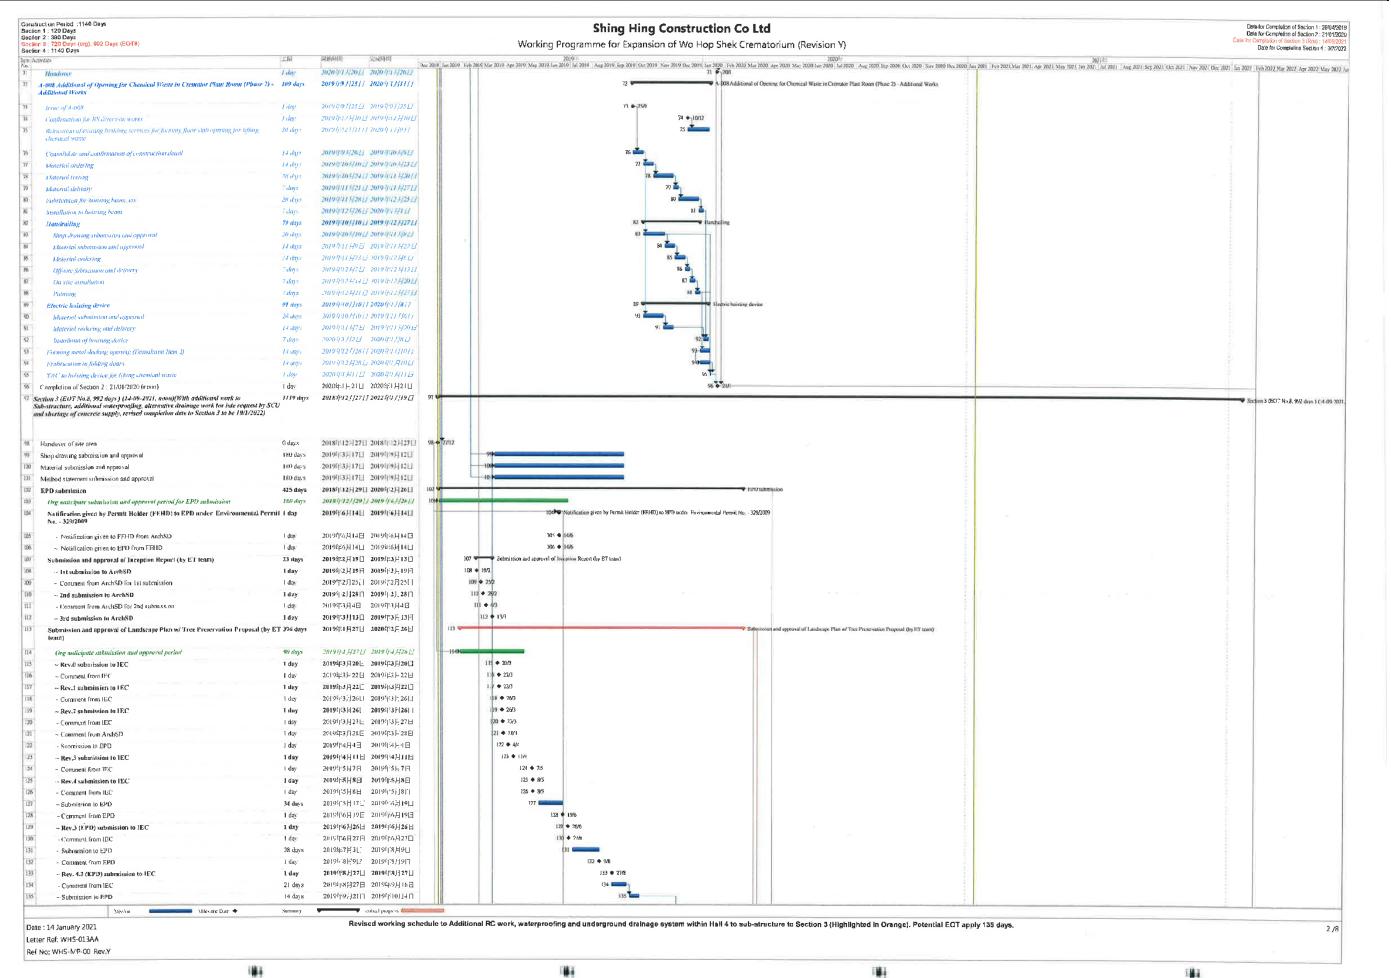




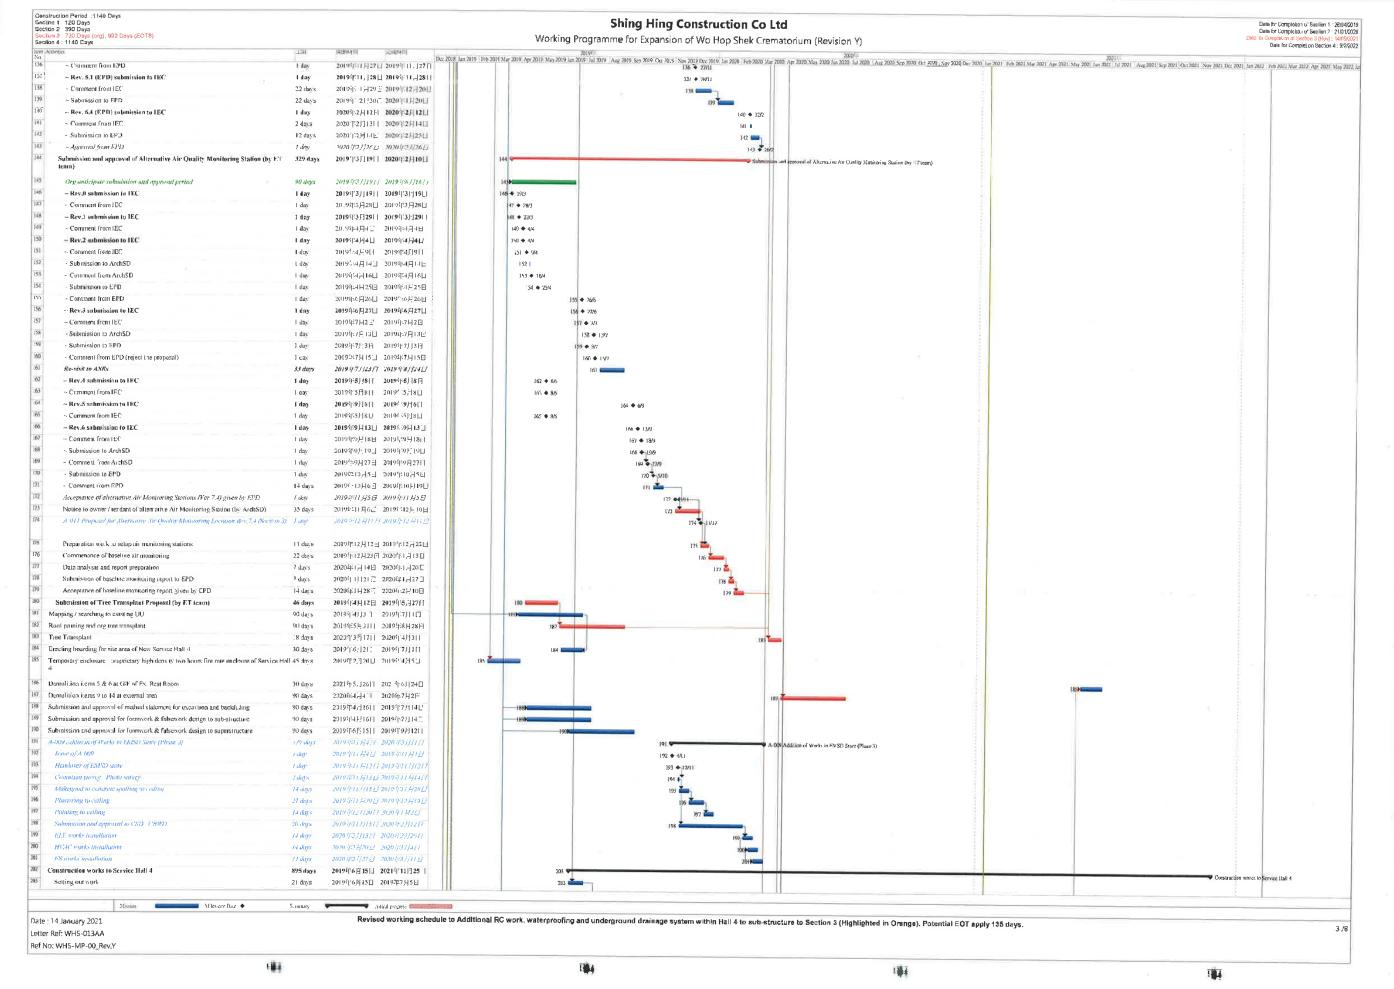




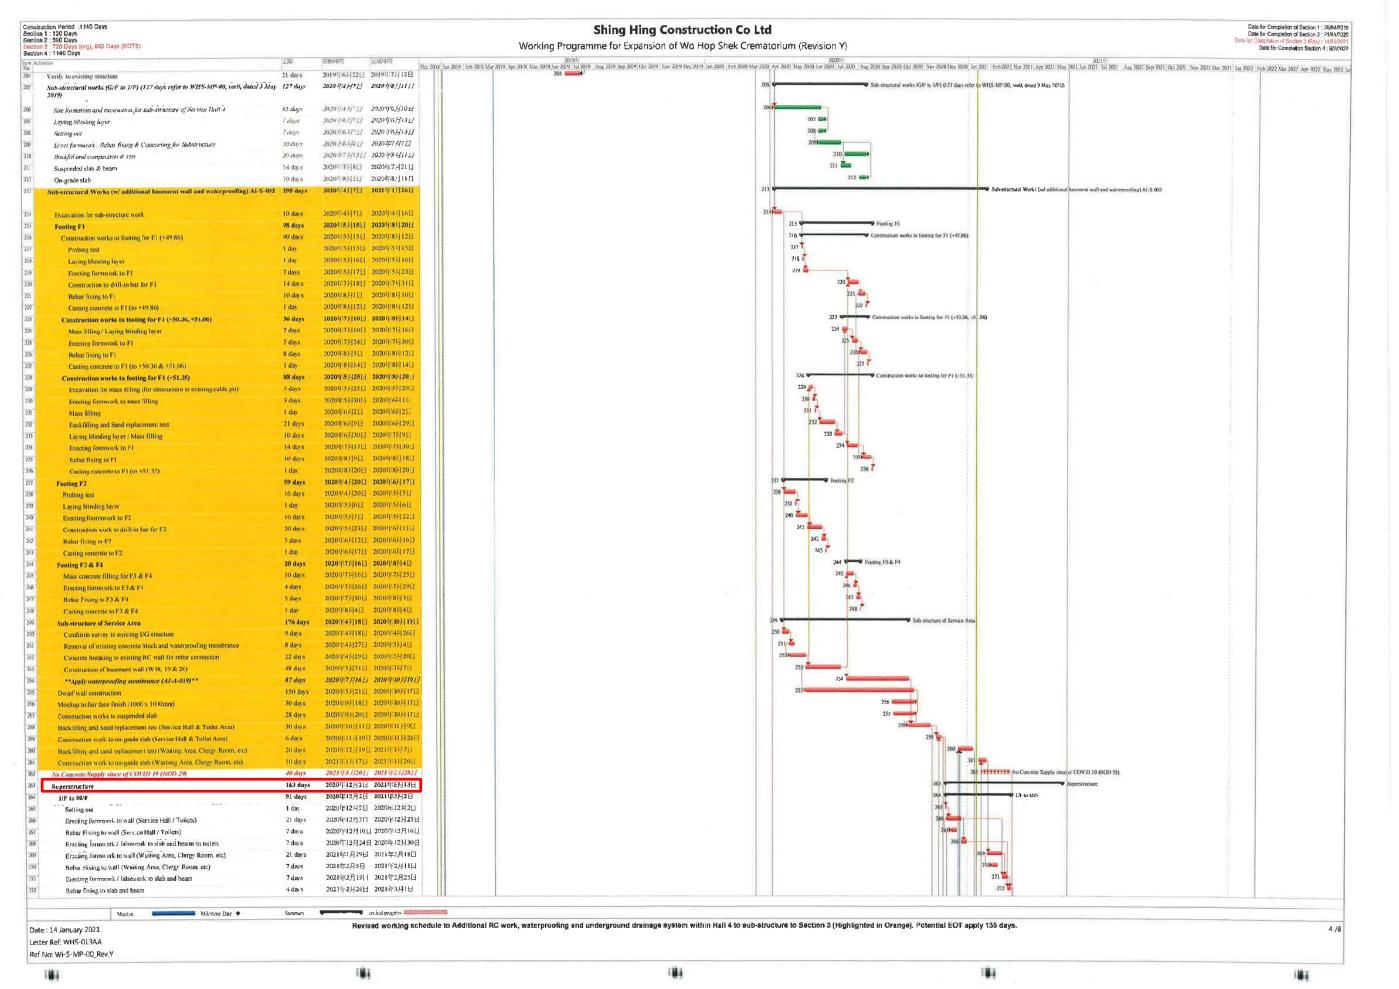




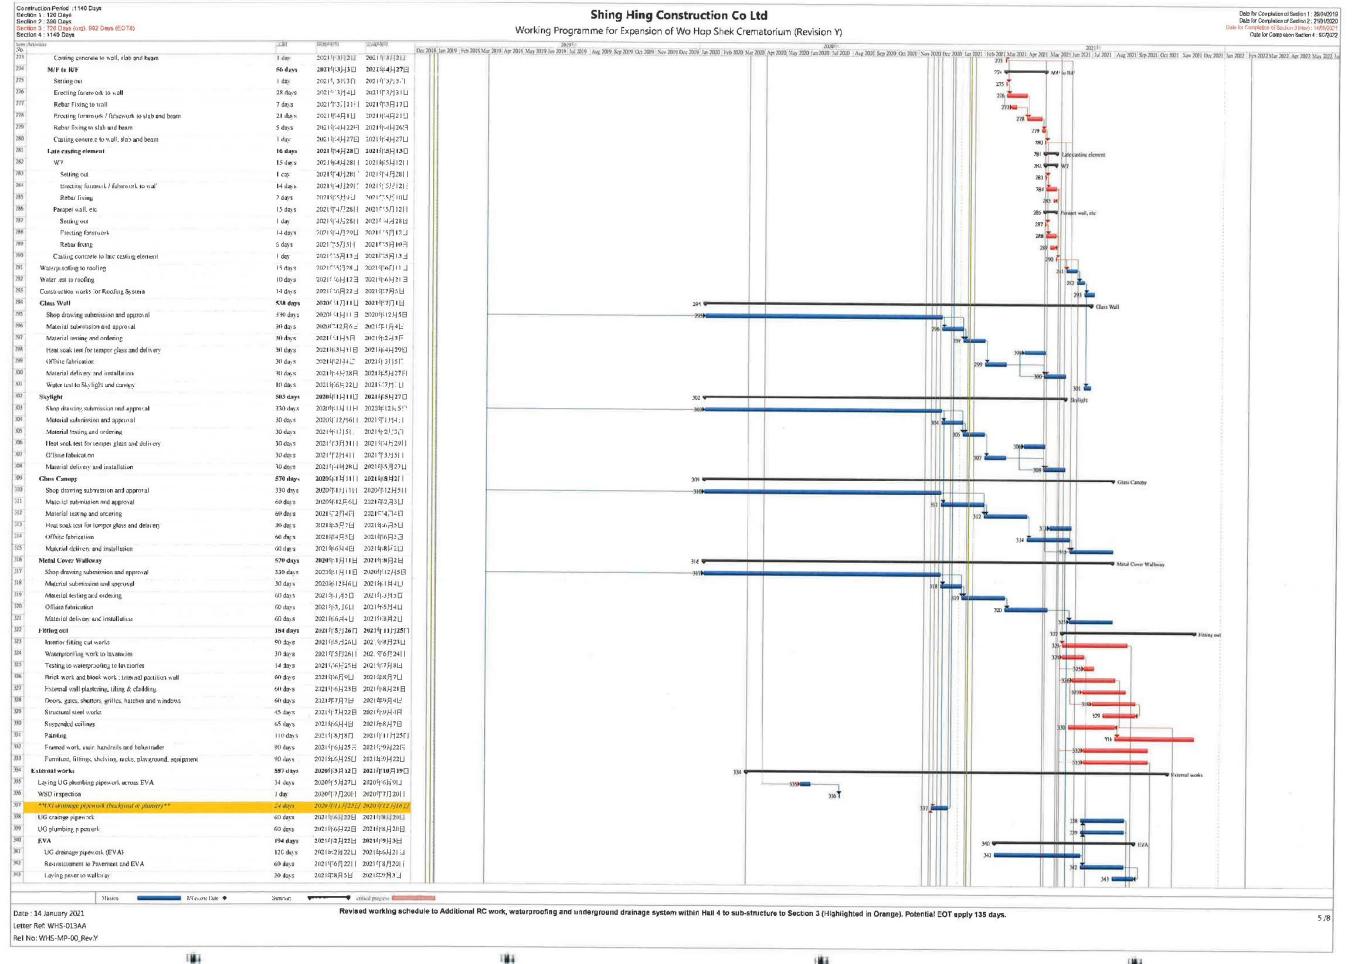




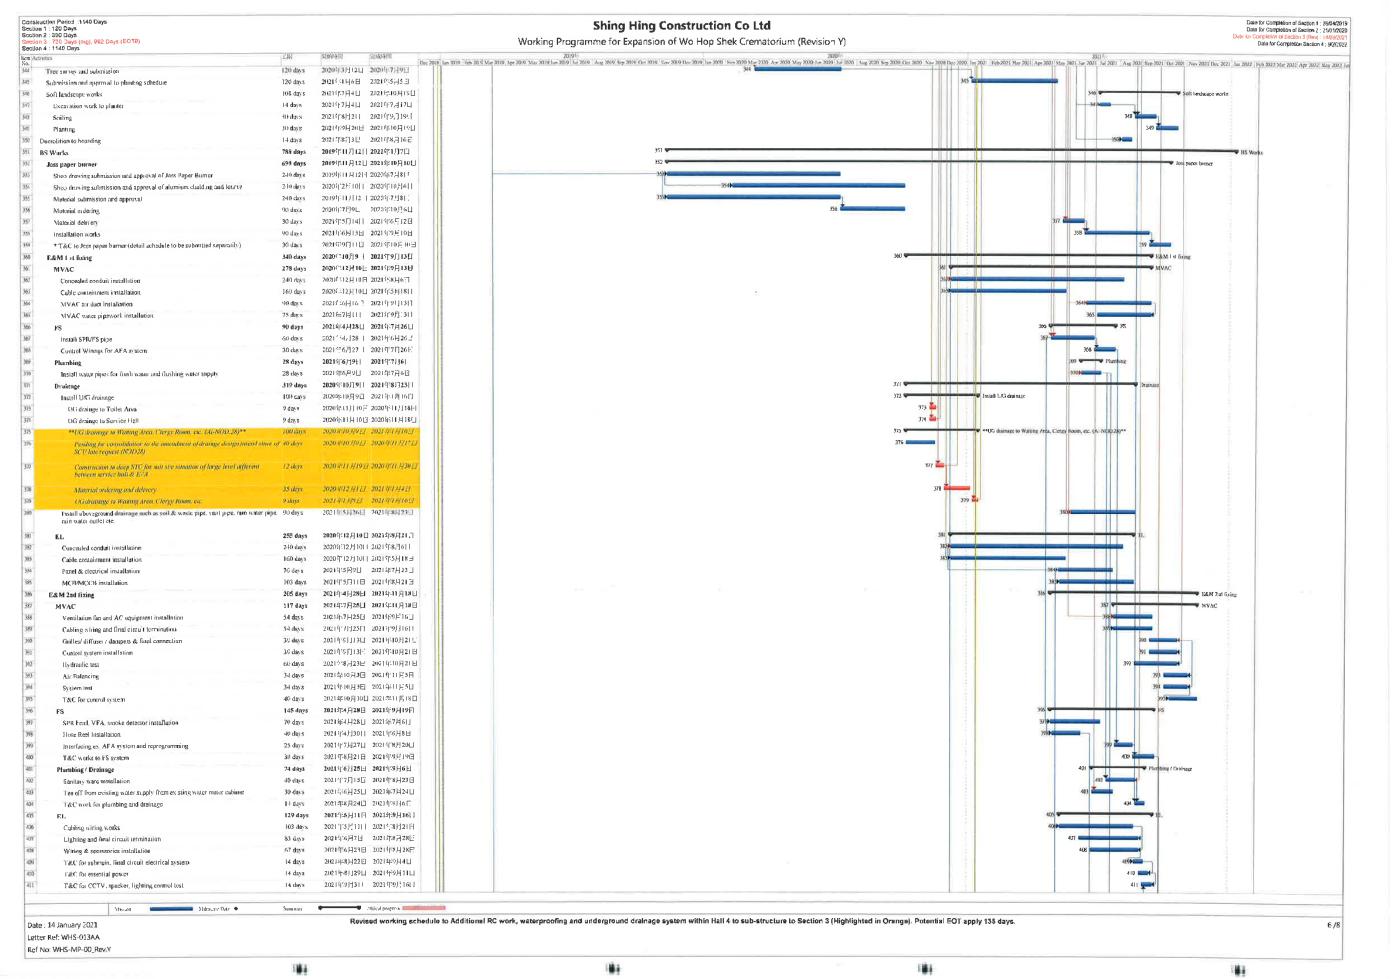



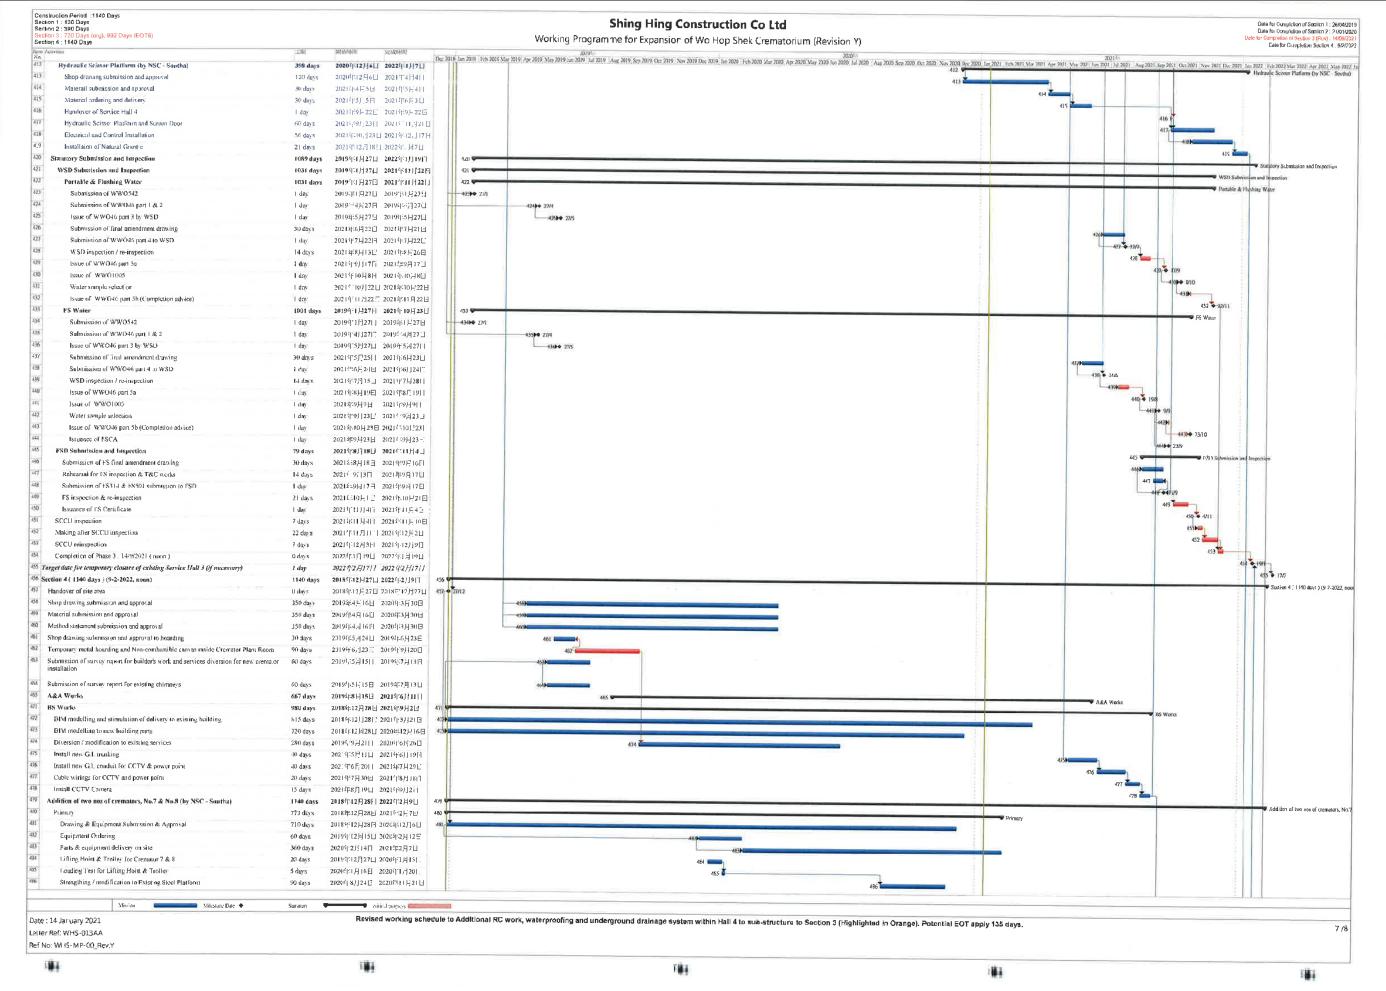




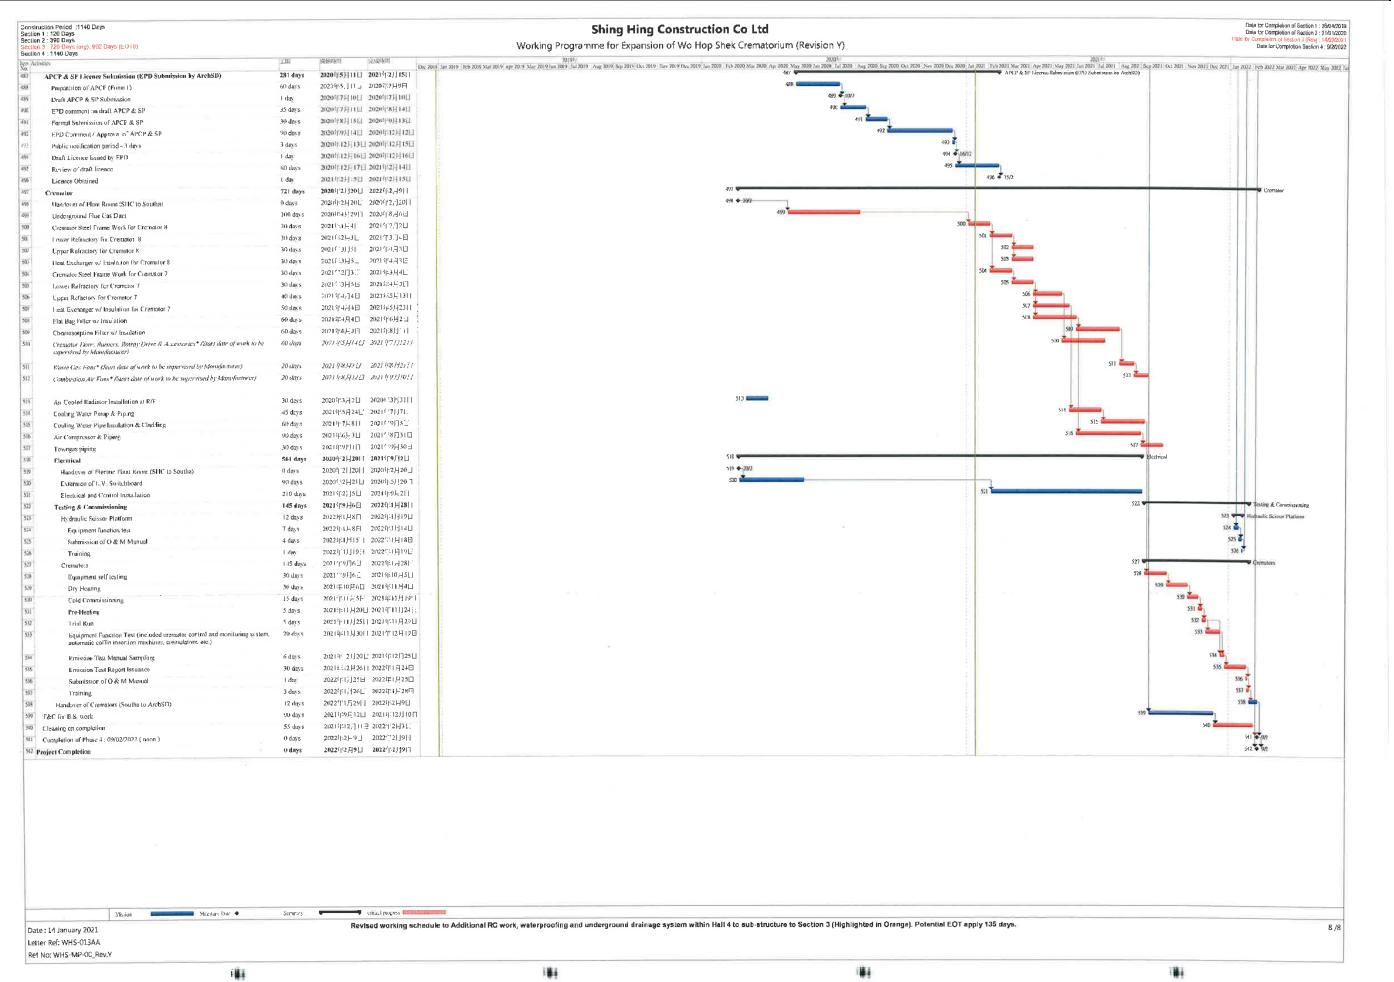



APPENDIX B: WORK AREA FOR THE CONTRACT NO. AL G513



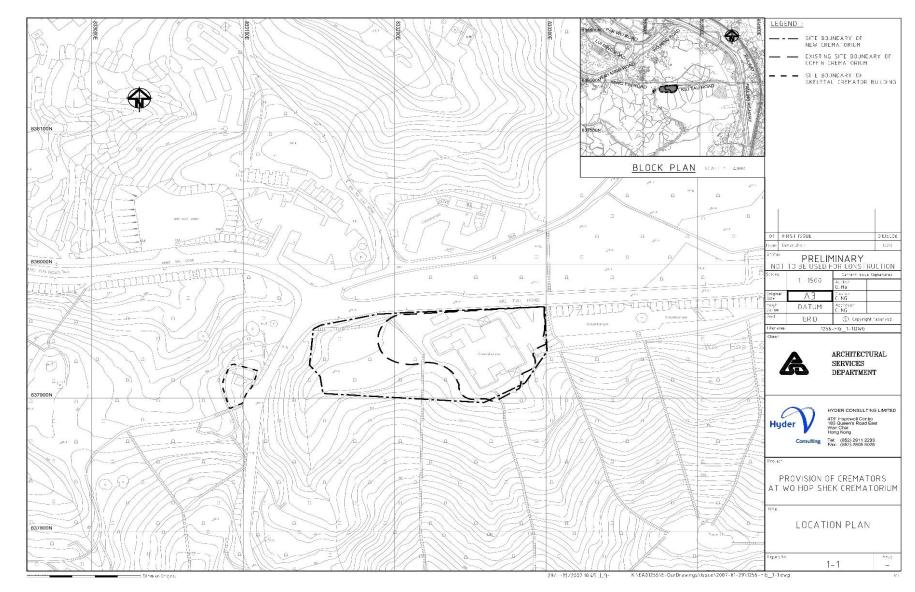



APPENDIX C: SUMMARY OF IMPLEMENTATION STATUS OF Environmental Mitigation



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
Air (Cons	truction	Phase)					
S.3.3.5		Under the Air Pollution Control (Specified Process) Regulation, an incinerator (including cremator) with an installed capacity exceeding 0.5 tonnes per hour, is classified as a specified process, and requires a Specified Process license to operate. FEHD shall apply for a specified licence under the APCO.	New Cremators in the New Crematorium / prior to operation	FEHD	Construction Phase	APCO	NA
S.3.9		Asbestos Investigation:	Incense burner,	Arch SD,	Construction Phase	APCO	NA
S.3.9.2			coffin and skeletal crematorium / Prior to any demolition	Registered Asbestos Consultant, Registered Asbestos		AIR and AAP	
S.3.9.3		If any ACM are identified in the existing crematorium, an asbestos abatement plan shall be submitted to EPD prior to any asbestos abatement works.	work commencing	Contractor			
S.3.9.4		The following precautionary and mitigation measures shall be implemented during the removal of ACM:					
		Enclosure of the work area.					
		■ Containment and sealing for the asbestos containing waste.					
		■ Provision of personal decontamination facility.					
		■ Use of personal respiratory/protection equipment.					
		Use of vacuum cleaner equipped with high-efficiency air particulate (HEPA) filter for cleaning up the work area.					
		■ Carrying out air quality monitoring during the asbestos abatement works.					



	1-TOTTET	HUITY LIVICET REPORT NO.13							
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status		
S.3.9.5		The following qualified personnel shall be appointed to carry out the asbestos abatement works:					NA		
		■ Registered asbestos contractor for carrying out the asbestos removal works.							
		Registered asbestos supervisor for supervising the asbestos abatement works.							
		Registered asbestos laboratory for monitoring the air quality during the asbestos abatement works.							
		Registered asbestos consultant for supervising and certifying theasbestos abatement works.							
S.3.9.7 -		Other Site Management:					NA		
S.3.9.9									
S.3.9.7		The asbestos materials in each building/premises must be abated before other contractors/trades are allowed to work in the building/premises.					NA		
S.3.9.8		Tight security measures shall be taken at the asbestos abatement works site to prevent any disturbance to ACM that may result from the stealing of valuable items on site such as electrical cable and copper pipes. It is recommended that priority shall be given for the abatement of all friable ACM.					NA		
S.3.9.9		As different contractors may be working on-site at the same time, the following measures should be considered:					NA		
		■ If there is a sensitive receptor around the area, conduct environmentalair monitoring at this off-site receptor.							
		■ Submit to EPD a completion report, including photos and air monitoring results, immediately after completion of asbestos abatement work for every work zone.							
S.3.9.9		As different contractors may be working on-site at the same time, the following measures should be considered:					NA		
		■ If there is a sensitive receptor around the area, conduct environmentalair monitoring at this off-site receptor.							
		■ Submit to EPD a completion report, including photos and air monitoring results, immediately after completion of asbestos abatement work for every work zone.							



	Tability Estat Report No. 20								
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status		
S.3.10.1 - S.3.10.2		The contractor has a responsibility to notify EPD for undertaking any 'notifiable' works prior to the commencement of such works. In addition, the contractor is also required to fulfil specific dust control requirements given in the APCO Regulation's Schedule for specific jobs.	Prior to 'notifiable' works including Construction of the foundation of a building and construction of the superstructure of a building	Contractor	Construction Phase	Air Pollution Control (Construction Dust) Regulation APCO	Implemented		
S.3.10.3 - S.3.10.4	S.2.9.1 - S.2.9.3	Good site management / practices to avoid / minimise incidences of dust emissions: Site Boundary and Entrance Vehicle washing facilities including a high pressure water jet shall be provided at every discernible or designated vehicle exit point. The area at which vehicle washing takes place and the section of the road between the washing facilities and the exit point shall be paved with concrete, bituminous or hardcore material. Access Haul Roads and Unpaved Areas Each and every main haul road shall be paved with concrete, bituminous hardcore materials or metal plates, and kept clear of dusty materials. Or Unpaved haul roads and areas shall be sprayed with water so as to keep the entire road surface wet.	Project Site / Construction and Demolition	Contractor	Construction Phase	Air Pollution Control (Construction Dust) Regulation APCO	Implemented		



14011	tiny Linear Report No.15					
EIA Ref		Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
	Excavated Materials					
	Any stockpile of dusty material shall be either: (a) covered entirely by impervious sheeting. (b) placed in an area sheltered on the top and the three sides. or (c) sprayed with water or a dust suppression chemical so as to maintain the entire surface wet.					
	Exposed Earth					
	Exposed earth shall be properly treated by compaction, hydroseeding, vegetation planting or seating with latex, vinyl, bitumen within six monthsafter the last construction activity on the site or part of the site where the exposed earth lies.					
	Loading, Unloading or Transfer of Dusty Materials					
	All dusty materials shall be sprayed with water immediately prior to any loading or transfer operation so as to keep the dusty material wet.					
	Debris Handling					
	Any debris shall be covered entirely by impervious sheeting or stored in a debris collection area sheltered on the top and the three sides.					
	■ Before debris is dumped into a chute, water shall be sprayed so that itremains wet when it is dumped.					
	Transport of Dusty Materials					
	■ Vehicles used for transporting dusty materials/spoils shall be covered with tarpaulin or similar material. The cover shall extend over the edges of the sides and tailboards.					
	Site Clearance					
	■ The working area for the uprooting of trees, shrubs, or vegetation or the removal of boulders, pole, pillars shall be sprayed with water immediately before, during and immediately after the operation so as to maintain the entire surface wet.					
	All demolished items shall be covered by impervious sheeting or placed in a spot with shelters on top and three sides within a day of the demolition.					
	■ Workers at all levels should be co-operative to avoid dust generation and dispersion to the surrounding environment.					



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
Air (FM&	A for Co	nstruction Phase		J			
S.11.2.4 - S.11.2.5	S.2.5 - S.2.6	Conduct baseline and regular 1-hr and 24-hr TSP monitoring at 2 measurement locations at a 6-day frequency	A22a and A22b / Baseline monitoring prior to construction works / Regular monitoring throughout construction period	Contractor	Construction Phase	EIAO	Implemented
		on Phase)	T				
S.4.4.9 - S.4.4.10	S.3.2.1 - S.3.2.2	Good Site Practice and Noise Management: Only well-maintained plant shall be operated on site and the plant shallbe regularly serviced during the construction works.	Work site / Construction phase	Contractor	Construction Phase	GW-TM & NCO	Implemented
		■ Plant used intermittently shall be turned off or throttled down when notin active use.					
		■ Plant that is known to emit noise strongly in one direction shall be oriented to face away from NSRs.					
		■ Silencers, mufflers and enclosures for plant shall be used where possible and maintained adequately throughout the works.					
		■ Mobile plant shall be sited away from NSRs.					
		■ Stockpiles of excavated materials and other structures such as site buildings shall be used effectively to screen noise from the works.					
		■ PME shall be well maintained and use properly on site to minimise the any excessive noise generated.					
Land Con	taminat	ion (Construction Phase)					
		Remedial Action Plan:	All areas	Contractor	Construction Phase	Waste Disposal	



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.5.7.2		If large amounts of contaminated soil (say 500m³) are found following further site investigation after the decommissioning of the crematorium, remediation options such as bioremediation for organics should be considered. Although disposal of smallamount of contaminated soil to landfills might be considered as an economic and acceptable option for remediation, it should be considered as the last resort if all remediation options including reuse are considered to be inappropriate or infeasible.	requiring remedial works in Project site			Ordinance (Cap.354) Waste Disposal (Chemical Waste) Regulations Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes CAP	NA
S.5.7.3		■ If disposal to landfills is chosen as the remediation measure, the criteria set primarily of Toxicity Characteristic Leaching Procedure (TCLP) limits, as stated in Annex E in the GN) should be met.				ProPECC Note PN3/94 Dutch A, B, C	NA
		■ At least three soil samples should be taken from the most contaminated area(s) and tested for TCLP for a full suite of parameters (16 metals) asstated in Table E1 in Annex E in the GN.				Classificati-on system	
		■ If the testing result shows that any of the TCLP limits cannot be met, the soil shall be treated by cement stabilization and further tested for TCLP prior to landfill disposal or treated as chemical waste and disposed of at the Chemical Waste Treatment Centre (CWTC).				WPCO Technical Memorandum on Standards for Effluents	
S.5.7.4		All soil treated as a chemical waste, shall be collected by a registered chemical waste contractor and the Waste Disposal (Chemical Waste) Regulations under the Waste Disposal Ordinance (Cap.354) shall be observed. Reference shall be made to the Registration of Chemical Waste Producers and Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes, issued by EPD.				Discharged into Drainage and Sewerage Systems, Inland and Coastal Waters (TM)	NA



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.5.7.6		Confirmatory Soil Sampling					NA
		 In order to confirm the extent of the soil contamination and if the contaminated soil should be removed or treated, confirmatory soil sampling shall be carried out during the remediation works. This shall consist of five to six samples in each location where soil contamination is identified from SI works. The locations will be to the north, south, east and west of the location where contaminated soil is found. Two locations should also be above and below the location (in terms of elevation) where contaminated soil is found. 					
		■ If analytical results exceed the Dutch B Levels or other agreed remedialtarget suggested in a supplementary CAR, the contaminated area shall be extended and further confirmatory sampling shall be carried out until no further contamination is encountered.					
S.5.8	S.4	Further Site Investigation	Areas that are currently in use	Contractor	Construction Phase	Interim CAR and RAP	NA
S.5.8.1	S.4.1 - S.4.7	Further site investigations in areas that are currently in use and cannot be accessed are required. These areas include the transformer room, dangerous goods stores, day tank room, fuel pump room, sunken fuel pipe and cremator.	and cannot be accessed, including the transformer room, dangerous			ProPECC Note PN3/94 Guidance Notes for Investigation and Remediation of	
S.5.8.2		The demolition contractor shall carry out further site investigations, after the decommissioning of the existing crematorium and skeletal cremator building.	goods stores, day tank room, fuel pump			Contaminated Sites of Petrol Filling Stations, Boatyards	
S.5.8.3		Potential contaminants in the soils have been identified in CAP and the parameters to be analysed for soils at different locations are summarised in Table 5-3 in S.5.8.3.	room, sunken fuel pipe and cremator.			and Car	



	MOTHER REPORT NO.15									
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status			
S.5.8.4		Sampling and analysis plans for these investigations shall be prepared and submitted to EPD for approval prior to any of these investigation works. Supplementary CAR and RAP shall be prepared to describe the results and findings of these site investigations and, if necessary, any remedial works.	After the decommissioni ng of the existing crematorium and skeletal cremator building.			Repair / DismantlingWorkshop s				
Land Con	l taminat	ion (EM&A)								
S.11.2.9	S.4.1 -	Further Site Investigation: Conduct further site investigation for Petroleum hydrocarbons	After decommissioni	Contractor	Construction Phase	Interim CAR & RAP	NA			
S.11.2.15	S.4.7	and PAH in soil samples.	ng, prior to							
		Conduct further site investigation for PCBs in soil samples.Conduct further site investigation for PAH, Dioxins and Metals	construction: Existing							
		(Cr, Co, Ni, Cu, Zn, As, Mo, Cd, Sn, Ba, Hg, Pb) in soil samples.	crematorium:							
			Dangerous goods store,							
			Daily tank							
			room, fuel							
			pump room and sunken fuel							
			pipe							
			Skeletal							
			Cremator Building:							
			Dangerous							
			goods store							
			Existing crematorium:							
			Transformer							
			room							
			Cremators (residual inside							
			the cremator,							
			flue and							



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
			chimneys				
	nagemer	nt (Construction Phase)					
S.6.7.24		Good Site Practice: ■ Obtain the necessary waste disposal permits from the appropriate authorities, if they are required, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28). ■ Obtain a billing account with EPD for disposal of construction waste. ■ A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) shall be prepared and submitted to the Engineer/Supervising Officer for approval. Reference shall be made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.	Project site/ design, construction and demolition stages	Contractor	Construction Phase	Waste Disposal Ordinance (Cap. 354) Waste Disposal (Chemical Waste) (General) Regulation Waste Disposal (Charges for Disposal of Construction Waste) Regulation	Implemented
		 Nomination of an approved person to be responsible for good site practice, arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site. Use of a waste haulier, authorised or licensed to collect specific category of waste. A trip-ticket system shall be included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference shall be made to ETWB TCW No. 31/2004. 					
		 Training of site personnel in proper waste management and chemicalwaste handling procedures. Separation of chemical wastes for special handling and appropriate treatment at a licensed facility. Routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors. Provision of sufficient waste disposal points and regular collection for disposal. Adoption of appropriate measures to minimise windblown litter and dustduring transportation of waste, such as covering trucks or transporting wastes in enclosed containers. Implementation of a recording system for the amount of wastes 					



	1.101161	ny Liver Report No.15				Controlling	LIMITED
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		generated, recycled and disposed of (including the disposal sites).					
S.6.7.25		Waste Reduction Measures: ■ Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. ■ Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by	Project site / construction and demolition stages	Contractor	Construction Phase	WBTC No. 32/1992 WBTC No. 19/2005	Implemented
		individual collectors. Separate labelled bins shall be provided to help segregate this waste from other general refuse generated by the work force. Any unused chemicals or those with remaining functional capacity shallbe recycled as far as practicable.					
		■ Reuse C&D materials when possible to reduce the amount of C&D material/waste.					
		■ Wood, steel and other metals shall be separated for reuse and / or recycling Prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill.					
		Minimise the potential for damage or contamination of construction material by having proper storage and site practices.					
		Plan and stock construction materials carefully to minimise the amount of waste generated.					



	1 101101	ny EMAA Report No.15				CONSULTING LIMITED		
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status	
S.6.7.4		Excavated Material Rock and soil generated from excavation shall be reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.	Project site / construction and demolition stages	Contractor	Construction Phase	WBTC No. 12/2000	Implemented	
S.6.7.5 - S.6.7.7	S.5.3.5 S.5.3.9	 Construction and Demolition Material Reuse of the public fill and C&D waste shall be practiced on site as faras practicable. The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) shall be directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites. Individuals or companies who deliver public fill to public filling areas require dumping licences. Careful design, planning and good site management can minimise over- ordering and generation of waste materials such as concrete, mortar and cement grouts. The design of formwork shall maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as. steel formwork, plastic fencing and reusable site office structures shall be considered to increase the potential for reuse and minimise C&D waste generation. The contractor shall use as much as possible of the C&D material onsite. Proper segregation of waste types on site will increase the 	Project site / construction and demolition stages	ArchSD / Contractor	Construction Phase	WBTC No. 2/93 The Land (Miscellaneous Provision) Ordinance WBTC No. 19/2005	Implemented	
		mortar and cement grouts. The design of formwork shall maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as. steel formwork, plastic fencing and reusable site office structures shall be considered to increase the potential for reuse and minimise C&D waste generation. In the contractor shall use as much as possible of the C&D material on-						



		y									
EIA Ref	EM&A Ref.	Environmental	l Protection Me	asures / Mitigati	on Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status	
S.6.11.1 - S.6.11.5	S.5.3.1 0 - S.5.3.1 4			ontamination Invest		Cremators, Flues Chimneys and surrounding areas / After	FEHD, ArchSD, Contractor	, ,	Construction Phase	ProPECC PN 2/97 ProPECC PN 3/94 APCO	NA
		After decommissioning but prior to demolition of the Existing Crematorium, the following further contamination investigations shall be carried out to confirm the quality and quantity of ash waste and building structures requiring treatment and disposal.				decommissioni ng but prior to demolition of the existing crematorium.	ecommissioni g but prior to emolition of ne existing		APCO		
		Location	Investigatio n Parameter	Investigatio n Period	Responsible Party	crematorium.					
		Cremators / flue / chimney and surround ing areas	Asbestos (building structures)	After decommissionin g but prior to demolition of the Existing	The Contractor						
		Cremators / flue / chimney and surrounding areas	Dioxins, heavy metals, PAH (ash waste)	Crematorium							
		 Prior to any demolition work commencing, these areas suspected to contain asbestos containing material (ACM) shall be further inspected by aregistered asbestos consultant to determine the presence of any ACM. These areas shall be thoroughly investigated and the additional findings submitted as supplementary information to the Asbestos Investigation Report. Samples shall be analysed for the presence and type of asbestos according to the Laboratory's HOKLAS accredited testing procedures. If the findings of the investigation indicate ACM 									
		materials prese	nt on the premise	s an Asbestos Abate encement of demolit	ment Plan						



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		■ It is not currently possible to conduct inspection and sampling within the cremators, chimney and flues to assess the levels of contamination due to the operation of the crematorium. It is recommended that samples shall be collected from the potential areas of contamination for testing of dioxin, heavy metal and PAH after decommissioning and prior to the demolition of the Existing Crematorium.					
S.6.9.6 - S.6.9.7	S.5.3.1 5 - S.5.3.1 7	 Asbestos Containing Material Asbestos wastes shall be handled in accordance with the Code of Practice on the Handling, Transportation and Disposal of Asbestos Waste issued by the Environment and Food Bureau. Production, collection and disposal of Asbestos waste will follow the 'trip-ticket' system. The registered asbestos contractor shall appoint a licensed asbestos waste collector to collect the packaged asbestos waste and deliver it to the designated landfill for disposal. Notification has to be given to EPD for its disposal. EPD will normally require ten working days notice of the intention to dispose of any quantity of asbestos waste. After processing the notification, EPD will issue specific instructions and directions for disposal of the waste. The waste producer or agent must strictly follow these directions. 	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Construction Phase	COP on Handling, Transportation and Disposal of Asbestos Waste under the Waste Disposal (Chemical Waste) (General) Regulation.	NA
		Dioxin Contaminated Materials (DCM) / Heavy Metal Contaminated Materials (HMCM) / Polyaromatic Hydrocarbon Contaminated Materials (PAHCM) from Demolition of the Existing Crematorium Proposed Contamination Classifications for Ash Waste with DCM / HMCM / PAHCM.	Cremator room in Existing Crematorium / before demolition and after decommission	Contractor	Construction Phase	ProPECC PN 3/94 APCO	NA



	MOHUI	ly EM&A Report No.15						CONSULTING	LIMITED
EIA Ref	EM&A Ref.	Environmental Protection	Measures / M	itigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
			ioxin Level in sh waste	Heavy Metal Level / Polyaromatic Hydrocarbon in Ash Waste					
		Low Contaminated <1 DCM/HMCM/PAHCM	1 ppb TEQ	< Dutch "B" List					
			1 ppb TEQ	> Dutch "B" List					
		Contaminated pp DCM	> 1 and < 10 ob TEQ	Any Level					
		Severely >1 contaminated DCM	10 ppbTEQ	Any Level					
S.6.9.9	S.5.3.1 9	Demolition, Handling, Treatmen DCM / HMCM / PAHCM from De			Cremator room in Existing Crematorium / demolition	Contractor	Construction Phase	ProPECC PN 3/94 APCO	NA
		■ Where the ash waste contains PAHCM, the contractor shall a during demolition. General du followed. The ash waste can be	avoid ash waste b ust suppression r	pecoming airborne neasures shall be					
S.6.9.10 - S.6.9.14	S.5.3.2 0 - S.5.3.2 4	Demolition, Handling, Treatmen Severely Contaminated DCM and Contaminated HMCM / PAHCM f Crematorium Site preparation procedures:	d Moderately / S	everely	Cremator room in Existing Crematorium / demolition	Contractor	Construction Phase	Waste Disposal (Chemical Waste) (General) Regulation ProPECC PN 3/94	NA
		Except the cremators/flue/chi items shallbe removed as far a decontamination activities.						APCO	
		Preliminary site decontaminat using High Efficiency Particula							
		■ A chamber with three layers o	of polythene shee	ets shall enclose the					



		J. T.					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		top portion of the chimney above the roof.					
		■ A 3-chamber decontamination unit shall be constructed at the entrance to the cremators/flues/chimney for entry and exit from the work area. It shall comprise a dirty room, a shower room and a clean room of at least 1m x 1m base with 3 layers of fire retardant polythene sheet.					
		Workers shall carry out decontamination procedures before leaving thework area.					
		All workers shall wear full protective equipment, disposable protective overall, nitrile gloves, rubber boots, and full-face positive pressure respirator.					
		Warning signs in both Chinese and English shall be put up in conspicuous areas.					
		Site preparation procedures specific to severely contaminated DCM:					
		■ The walls, floor and ceiling of the cremator room shall be lined with 3-layers of fire retardant polythene sheets.					
		■ Air movers shall be installed at the cremator room, and at the bottom of the chimney to exhaust air from the work area. A stand by air mover shall also be installed with each of the air movers. Sufficient air movement shall be maintained to give a minimum of 6 air changes per hour to the work area.					
		■ New pre-filters and HEPA filters shall be used on the air movers.					
		■ Before commencement of the decommissioning work a smoke test with non-toxic smoke shall be carried out to ensure the air tightness of the containment.					
		Demolition and handling procedures:					
		■ The cremators/flue/chimney shall be removed from top down.					
		Scrubbing and HEPA vacuuming shall be used to remove any ash or residues attached to the cremators, flue, chimney and other building structures.					
		■ Wastes generated from the contaminant or decontamination unit including the workers protection clothing shall be disposed of at landfill site.					
		After completion of removal, all surfaces shall be decontaminated by HEPA vacuum.					
		■ If any contaminated wastewater needs to be discharged out of the					



		ny Eliteri Report No.13					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		site, it shall be properly treated to WPCO requirements with prior agreements with EPDon discharge standards.					
		Demolition and handling procedures specific to severely contaminated DCM:					
		■ The contaminated detached sections of the building structures shall be wrapped with 2 layers of fire retardant polythene sheets. A third layer shallbe wrapped and secured with duct tape. Wet wiping shall be used to decontaminate the outer layer.					
		■ After completion of removal and decontamination, spray the innermost layer of the fire retardant polythene sheet with PVA. Upon drying, peel off and dispose of at landfill site. Repeat for the other 2 layers disposing the final layer as contaminated wastes.					
		Treatment and disposal procedures:					
		■ Immobilise the ash waste by mixing with cement in the correct ratio as determined by pilot mixing and TCLP test.					
		■ Place material in polythene lined steel drums for disposal at landfill. The drums should clearly be marked with "DANGEROUS CHEMICAL WASTE" in English and Chinese. Prior agreement of the disposal criteria must be obtained from EPD and the landfill operator.					
		■ If the landfill disposal criteria cannot be met, disposal at the CWTC in TsingYi shall be considered.					
S.6.9.1	S.5.3.2	Chemical Waste	Project site /	Contractor	Construction Phase	Code of Practice on the	Implemented
S.6.9.2	5 -	■ Should any chemical waste be generated, the Contractor must registerwith the EPD as chemical waste producer.	demolition			Packaging, Labelling and Storage of	
	S.5.3.7	■ All the chemical waste shall be handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste shall be stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.				Chemical Wastes Waste Disposal (Chemical Waste) (General) Regulation.	
		■ Principles of reuse and recycle chemical waste on site as far as practicable shall be adopted by the Contractor.				(General) Regulation.	



		Ty Eliteri Report No.15					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.6.9.3	S.5.3.2	Containers used for the storage of chemical waste shall:					
	8	■ Be suitable for the substance they are holding, resistant to corrosion, maintained in good condition, and securely closed.					
		■ Have a capacity of less than 450 litres unless the specifications have been approved by the EPD.					
		Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation.					
S.6.9.4	S.5.3.2	The storage area for chemical waste shall:					
	9	■ Be clearly labelled and used solely for the storage of chemical waste.					
		■ Be enclosed on at least 3 sides.					
		■ Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest.					
		■ Have adequate ventilation.					
		■ Be covered to prevent rainfall entering (water collected within the bundmust be tested and disposed as chemical waste if necessary).					
		Be properly arranged so that incompatible materials are adequately separated.					
S.6.9.25	S.5.3.3	Disposal of chemical waste shall be:					
	0	■ Via a licensed waste collector.					
		■ A facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers. or					
		■ A waste recycling plant approved by EPD.					



	MONITHY EMAA REPORT NO.15						
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.6.7.27	S.5.3.3	General Refuse	Project site /	Contractor	Construction Phase		Implemented
S.6.7.28	1 - S5.3.3 2	 General refuse shall be stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector shall be employed by the contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts. Individual collectors often recover aluminium cans from the waste stream if they are segregated or easily accessible. Therefore, separately labelled bins for their deposit shall be provided if feasible. Similarly, plastic bottles and carton package material generated on site shall be separated for recycling as far as possible. Site office waste shall be reduced through recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme shall be considered if one is available. 	construction and demolition stages				
Waste Ma	nageme	ent (EM&A)					
S.11.2.17	S.5.3.1 0	Supplementary site investigations shall be conducted for asbestos in building structures and for dioxins, heavy metals and PAH in ash/particular matter samples.	Cremators / flue / chimney and surrounding area. After decommissioni ng but prior to demolition	Contractor	Construction Phase	ProPECC PN 2/97 and 3/94 AIR, AMP/AAP to be submitted under APCO Future Supplementary Investigation Site Plan	NA
		isual (Construction Phase)	T	Г		Γ	Т
S.7.9.2 MC 1	S.6.3.1	 Site offices and construction yards: Site offices shall have olive green roof and façade coating or colour matches with existing environment. Site offices and the construction yard shall be decommissioned after construction. 	All site offices / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 2	S.6.3.1	 Height of site offices: The height of site offices, including the rooftop shall not exceed 10m. Building services equipment such as antennas may exceed 10m and shall be coated in black. 	All site offices / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.7.9.2 MC 3	S.6.3.1	Hoarding and screening: Where practical the site offices areas, construction yards and storage areas shall be screened using colour in harmony with the surrounding environment around the peripheries of the works area until the completion of relevant construction phases.	All site offices and construction yard areas / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 4	S.6.3.1	 Construction plant and building material: Shall be orderly and carefully stored in order to appear neat and avoid visibility from outside where practical. Excess materials shall be removed from site as soon as practical. All construction plants shall be removed from site upon completion of construction works. 	Works site / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 5	S.6.3.1	Construction light: To be oriented away from the viewing location of VSRs. All lighting facing sensitive receiver shall have frosted diffusers and reflective covers.	All construction lights / Design and construction phases	ArchSD's Contractor	Construction Phase		Implemented
S.7.9.2 MC 6	S.6.3.1	Silting trap: Silting traps shall be installed to minimise silting to streams.	Streams / Construction phase	Contractor	Construction Phase		NA
S.7.9.3 MT 1	S.6.3.1	Compensation for losses: The tree compensation to tree loss ratio shall be at least 1:1 in term of quantity.	Within the Wo Hop Shek Crematorium	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004 ETWB TCW No. 3/2006	NA
S.7.9.3 MT 2	S.6.3.1	Where practical, trees that require removal shall be transplanted on Site.	Work site / Design and construction phases	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004 ETWB TCW No. 3/2006	Implemented



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.7.9.3 MT 3	S.6.3.1	 Amenity planting: Planting works shall be carried out under the supervision of a specialist landscape sub-contractor. The rooftop of the cremation plant room shall be planted with lawn. Open spaces shall be included Project. Screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road shall be carried out. New trees, shrubs and groundcover shall be carefully selected and designed to homogenize with the environment. 	As shown on mitigation measure plans / All phases	ArchSD's & FEHD's Contractor	Construction Phase	ETWB 2/2004	NA
S.7.9.3 MT 4	S.6.3.1	Woodland mix planting: Woodland mix, comprising of tree seedlings and shrubs, shall be planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Within the Wo Hop Shek Cemetery / All phases	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004ETWB TCW No. 3/2006	NA
S.7.9.3 MT 5	\$.6.3.1	Preservation: No tree shall be transplanted or felled without prior approval by relevant Government departments. All trees that are marked for retention shall be fenced off with a 1.2mhigh fence around the dripline of trees or larger area as far as feasible. Transplant preparation works shall be carried as soon as possible after commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping shall be avoided. Rootball and crown pruning shall be carried out over at least 3 months. Existing shrub and ground cover planting areas that will not be removed shall be maintained in good condition and enhanced where practical.	Work site / All phases	ArchSD's Contractor	Construction Phase	ETWB TCW No. 2/2004 ETWB TCW No.	Implemented
S.7.9.4 MB 1	S.6.3.1	The 10m height headroom cremation plant room shall be half sunken to reduce the visual impact to pedestrians.	Cremation plant room / Design phase	ArchSD's Contractor	Construction Phase		NA
S.7.9.4 MB 2	S.6.3.1	The chimney shall be designed to have sculptural outlook and articulated.	Chimney / Design phase	ArchSD's Contractor	Construction Phase		NA
S.7.9.4 MB 3:	S.6.3.1	The chimney stacks shall be designed to locate at the least conspicuous location of the site to VSRs.	Chimney / Design phase	ArchSD's Contractor	Construction Phase		NA
Landscap	e and Vi	isual (EM&A)					



EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.11.2.23	S.6.2	Details of the inspection frequency and parameters will be outlined in the EM&A Manual.	Work site / Construction	Contractor	Construction Phase		NA
S.11.2.24		onstruction Phase)					
	S.7.2.2	Construction Runoff and Drainage	Work site /	Contractor	Construction Phase	ProPECC PN 1-	Implemented
3.0.7.1	3.7.2.2	5	Construction	Contractor	Constituction Filase	94 & WPCO	implemented
S.8.7.4		■ Wastewater shall be properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams shall be allowed.	Constituction			94 & WIGO	
		■ Provision of perimeter channels to intercept storm runoff from outside the Site. These shall be constructed in advance of site formation works andearthworks.					
		■ Sand/silt removal facilities such as sand traps, silt traps and sediment basins should be provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.					
		■ Works shall be carefully programmed to minimise soil excavation works during rainy seasons.					
		Exposed soil surface shall be protected by paving as soon as possible to reduce the potential of soil erosion.					
		■ Temporary access roads shall be protected by crushed gravel and exposed slope surfaces shall be protected when rainstorms are likely to occur.					
		■ Trench excavation shall be avoided in the wet season as far as practicable, and if necessary, these trenches shall be excavated and backfilled in short sections.					
		■ Open stockpiles of construction materials on Site shall be covered with tarpaulin or similar fabric during rainstorms.					
		■ Sand and silt in the wash water from the wheel from the wheel washing facility shall be settled out and removed before discharging into the storm drain.					
		■ Oil receptor shall be provided in the drainage system and regularly emptied to prevent the release of oil and grease into the storm drainage system after accidental spillage.					



	Monthly Lividix Report No.15						
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
S.8.7.5	S.7.2.3	General Construction Activities	Work site /	Contractor	Construction Phase	ProPECC PN 1-	Implemented
		Debris and rubbish generated on Site shall be collected, handled and disposed of properly to avoid them entering the two streams.	Construction phase			94 & WPCO	
		All fuel tanks and storage areas shall be provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storagecapacity of the largest tank.					
		Open storm water drains and culverts near the works area shall be covered to block the entrance of large debris and refuse.					
S.8.7.6	S.7.2.4	Sewage from On-site Workforce:	Work site /	Contractor	Construction Phase	WPCO	Implemented
		■ Portable chemical toilets shall handle the sewage from construction work force if the existing toilets in the Site are not adequate. Licensed contractors who shall be responsible for appropriate disposal and maintenance of these facilities shall provide appropriate and adequate portable toilets.	Construction phase				
		■ Sheet piling shall be provided at suitable location around the basement excavation to reduce the effect of lowering the water table from any dewatering process. Any discharge of groundwater pumped out from any dewatering process of the construction works shall be treated to comply with the standards set in the relevant discharge licence prior discharge. No discharge of the groundwater shall be allowed into the two streams.					
Ecology (Constru	ction Phase)					
S.9.8.3 -	S.8.3.1	 Mitigation to minimise impacts on habitat and vegetation loss: Layout of the Project shall be carefully designed to avoid or minimise thearea of habitat loss and the numbers to trees to be felled. All trees shall be preserved as far as possible, especially species of conservation concern. Recommendations to be provided in the Tree Survey Report to mitigate impacts on trees shall be followed. Disturbance of individuals of the shrub / tree Transplantation of the two shrub / tree species of conservation concern, namely Aquilaria sinensis and Cibotium barometz, shall be avoided. Where loss of these species would be unavoidable, it is recommended to transplant them to same habitats with similar conditions. Following transplantation, regular monitoring of these trees shall be conducted by a suitable qualified botanist / horticulturist over a 12- 	Work site particularly semi- natural woodland / Design and construction phases.	Arch SD / Contractor	Construction Phase	ETWB Technical Circular No. 3/2006	Implemented



	1 101101	ly Linear Report No.15					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
20045	0.001	month period. Transplantation of any affected trees to grassland / scrubland within theWo Hop Shek Cemetery. Compensatory planting of the felled trees shall follow the Technical Circular No. 3/2006 issued by ETWB.			Construction Phone		
S.9.8.15 - S.9.8.16	S.8.3.1	Mitigation to construction runoff through general good site practice:	Work site / Construction phase	Contractor	Construction Phase	ETWB Technical Circular (Works) No. 5/2005.	Implemented
		■ Temporary access to the work sites shall be carefully planned and located to minimise disturbance caused to the streams and nearby habitats.					
		Use of less or smaller construction plant may be specified toreduce disturbance to the streams and nearby habitats.					
		■ Temporary sewage system shall be designed and installed to collect wastewater and prevent it from entering the streams and nearbyhabitats.					
		■ The Site inside or in the proximity of the streams and nearby habitats shall be temporarily isolated, such as by placing of sandbags or silt curtains with lead edge at bottom and properly supported props, to prevent adverse impacts on these areas.					
		■ Natural bottom and existing flow in the streams shall be preserved as muchas possible to avoid disturbance to the stream habitats.					
		■ Proper locations well away from the streams and nearby habitats for temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil shall be identified before commencement of the works.					
		■ Stockpiling of construction materials, if necessary, shall be properly covered and located away from the streams and nearby habitats.					
		■ Construction debris and spoil shall be covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.					
		■ Construction effluent, site runoff and sewage shall be properly collected and/or treated.					



	Monthly Electric No.15						
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		■ Proper locations for discharge outlets of wastewater treatment facilities well away from the streams and nearby habitats shall be identified.					
		■ Vehicles and other plant shall be carefully maintained and properly used to minimise the chance for accidental spillage.					
		Any spillages that do occur shall be quickly identified and appropriately cleaned up before they can contaminate streams or groundwater.					
		■ Temporary geo-textile silt fences around earth moving works shall beerected to trap any sediments being washed away and prevent them from entering surrounding areas.					
		■ Silt traps shall be installed at points where drainage from the Site enters temporary sewage system.					
		■ Exposed soil or other loose materials shall be covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geo- textile blanket for erosion control purposes.					
S.9.8.18		Mitigation to protect the groundwater:	Work site /	Contractor	Construction Phase		NA
		■ Basement formation or any construction activities likely to pump out a large quantity of groundwater shall be protected with sheet-piling at suitable locations around the basement footprint, or by any like method.	Construction phase				
		■ No groundwater shall be pumped back to the two stream courses to protect the natural integrity of the stream habitat and the associated organism.					
S.9.8.20	S.8.3.1	Mitigation for noise and other disturbance on ecological integrity:	Work site /	Contractor	Construction Phase		Implemented
		■ Use of sturdy 1.8 metres protective fencing shall be located at the edge of the tree canopy but not around the trunk.	Construction phase				
		■ Works beneath the tree canopy shall be avoided: If encroachment under the canopy area is unavoidable, adequate protections shall be provided to ensure no damage of any part of the tree would occur due to the encroachment.					
		■ An approved Landscape Contractor shall implement any tree transplanting and planting works. Quality control of the work shall be undertaken by a qualified Landscape Architect through site inspections and approval of works.					



		ny minani kepolitivo.15					
EIA Ref	EM&A Ref.	Environmental Protection Measures / Mitigation Measures	Location / Timing	Implementation Agent	Implementation Stage	Relevant Legislation and Guidelines	Implementation Status
		 Construction works shall be restricted to works area which are clearly defined. Woodland or other habitats that would be affected by the construction works shall be well-defined and minimised. Human inference to habitats beyond the site boundary and habitats proposed to be retained shall be avoided by providing temporary barricades. Works area shall be reinstated immediately after completion of the construction. Waste and other garbage generated during the construction of the proposed development shall be dumped properly. Uncontrolled fire shall be strictly prohibited. Appropriate fire control measures shall be provided in order to protect nearby 					
Ecology (ΈΜ <i>ឱ</i> ,Δ)	habitats.					
S.9.11	S.8.2.1	Audit/Inspection:	Work site /	Contractor	Construction Phase		Implemented
& S.11.2.29		Regular site audit / inspection shall be conducted at least once a week to inspect the implementation of the recommended mitigation measures (details to be outlined in the EM&A Manual).	Construction phase				P · · · · · ·
S.11.2.32	S.8.2.2	Monitoring on Transplantation:	Work site /	Contractor	Construction Phase		Implemented
S.11.2.33	- S.8.2.4	■ Trees requiring transplantation or protection shall be identified based on the information illustrated in the Tree Survey Report.	Construction phase				
		■ Regular monitoring after transplantation of Aquilaria sinensis and Cibotium barometz individuals shall be conducted to check on the health and conditions of the plants. Monitoring shall cover the 12-month period following transplantation. The monitoring shall be conducted by a suitably qualified botanist / horticulturist at least twice a month for the first four months after transplantation, and once a month for the remaining eight months.					



APPENDIX D: IMPACT MONITORING SCHEDULE OF THE REPORTING MONTH



Impact Monitoring Schedule for Expansion of Wo Hop Shek Crematorium May-21 Mon Wed Weekly ET site inspection and Air monitoring for A10, A20 for 1hr TSP and 24-hr TSP Monitoring Time: 0900-1630 Air monitoring for A10, A20 for 1 Weekly ET site inspection and hr TSP and 24-hr TSP Monitoring Time: 0900-1630 Air monitoring for A10, A20 for 1 Air monitoring for A10, A20 for 1 hr TSP and 24-hr TSP Weekly ET site inspection and hr TSP and 24-hr TSP Monitoring Time: Monitoring Time: 0900-1630 0900-1630 Air monitoring for A10, A20 for 1-Weekly ET site inspection and hr TSP and 24-hr TSP Monitoring Time: 0900-1630

2. Advance notification of the changes will be given to all relevant parties at lease 48 hours prior to implementation.

^{*}Remarks: 1. This impact monitoring schedule is subject to change due to adverse weather conditions or other rationales.



APPENDIX E: EVENT/ACTION PLAN FOR DUST EXCEEDANCE



Event	Action							
Event	ET	IEC	AR	Contractor				
Action Level								
1. Exceedance for one sample	 Identify source, investigate the causes of complaint and propose remedial measures; Inform IEC and AR; Repeat measurement to confirm finding; Increase monitoring frequency to daily. 	 Check monitoring data submitted by ET; Check Contractor's working method. 	1. Notify Contractor.	 Rectify any unacceptable practice; Amend working methods if appropriate. 				
2. Exceedance for two or more consecutive samples	 Identify source; Inform IEC and AR; Advise the AR on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and AR; 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Submit proposals for remedial to AR within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 				



Event	Action							
Event	ET	IEC	AR	Contractor				
	If exceedance stops, cease additional monitoring.							
Limit Level								
1. Exceedance for one sample	 Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC, AR, Contractor and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and AR informed of the results. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the AR on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; Ensure remedial measures properly implemented. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 				
2. Exceedance for two or more consecutive samples	 Notify IEC, AR, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working 	 Discuss amongst AR, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the AR accordingly; 	 Confirm receipt of notification of exceedance in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; 				



Event	Action							
Event	ET	IEC	AR	Contractor				
	procedures to determine possible mitigation to be implemented; 6. Arrange meeting with IEC and AR to discuss the remedial actions to be taken; 7. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and AR informed of the results; 8. If exceedance stops, cease additional monitoring.	3. Supervise the implementation of remedial measures.	 4. Ensure remedial measures properly implemented; 5. If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 4. Resubmit proposals if problem still not under control; 5. Stop the relevant portion of works as determined by the AR until the exceedance is abated. 				



APPENDIX F: DUST MONITORING EQUIPMENT CALIBRATION CERTIFICATE



創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	Fung Kai Liu Yun Sum Memorial School	Site ID:	A10	Date:	05-May-2021
Serial No:	1049	Model:	TE-5170X	Operator:	Casey Lau

Ambient Condition

Corrected Pressure (mm Hg):	759.7	Temperature (deg K):	299.6
-----------------------------	-------	----------------------	-------

Calibration Orifice

Model:	TE-5025	Slope:	1.29575
Serial No.:	3465	Intercept:	-0.01116
Calibration Due Date:	23-Sep-21	Corr. Coeff:	0.99995

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.25	0.869	34.9	34.76
2	2.06	1.112	37.8	37.74
3	3.02	1.345	41.1	40.95
4	4.02	1.552	43.7	43.61
5	4.88	1.709	46.2	46.05

Sampler	Calibtation	Relationship	(Oa on v.	avic IC on	w_avie)
Sampler	Cambiation	Relationship	(Oa on x-	axis, ic on	v-axis)

Checked by:

Sampler Calib	otation Relationship (Qa o	n x-axi	s, IC on y-axis)		
m=	13.3985	b=	22.9716	Corr. Coeff=	0.9994
Sampl	ler set point(SSP)	39	CFM		
		С	alculations		
Qstd = 1/m[Sqrt]	t(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/P)]	Pstd)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard	flow rate		Tav = average temperature		
IC = corrected c	hart response		Pav = average pressure		
I = actual chart i	response				
m = calibrator (Qstd slope				
b = calibrator Q	1) Std intercept				
Ta = actual temp	perature during calibration (de	gK)			
Pa = actual pres	sure during calibration (mm H	(g)			
Tstd = 298 deg	K				
Pstd = 760 mm	Hg				
For subsequent	calculation of sampler flow:				
(1.21*m+b)/[Sq	rt(298/Tav)(Pav/760)]				

The copyright of this document is owned by Acuity Sustainability Consulting Limited. It may not be reproduced except with prior written approval from the Company.

Date:

05-May-2021



創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	Fung Kai Liu Yun Sum Memorial School	Site ID:	A10	Date:	17-May-2021
Serial No:	1049	Model:	TE-5170X	Operator:	Casey Lau

Ambient Condition

Corrected Pressure (mm Hg):	757.4	Temperature (deg K):	303.4
-----------------------------	-------	----------------------	-------

Calibration Orifice

Model:	TE-5025	Slope:	1.29575
Serial No.:	3465	Intercept:	-0.01116
Calibration Due Date:	23-Sep-21	Corr. Coeff:	0.99995

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.23	0.856	34.2	33.84
2	2.06	1.104	37.2	36.84
3	3.04	1.340	40.5	40.07
4	4.07	1.549	43.2	42.75
5	4.96	1.708	45.7	45.21

Sampler Calib	otation Relationship (Qa or	ı x-axi:	s, IC on y-axis)			
m=	13.2873	b=	22.3161	Corr. Coeff=	0.9993	
Sampl	er set point(SSP)	39	CFM			
		С	alculations			
Qstd = 1/m[Sqrt]	(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope			
IC = I[Sqrt(Pa/F	Pstd)(Tstd/Ta)]		b = sampler intercept			
			I = chart response			
Octd - ctandard	flow rate		Toy - overage temperature			

Qstd = standard flow rate Tav = average temperatureIC = corrected chart response Pav = average pressure I = actual chart response

m = calibrator Qstd slope b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg KPstd = 760 mm Hg

For subsequent calculation of sampler flow: (1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Checked by:	Date:	17-May-2021
<u> </u>		



創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	Fanling Government School	Site ID:	A20	Date:	05-May-2021
Serial No:	1050	Model:	TE-5170X	Operator:	Casey Lau

Ambient Condition

Corrected Pressure (mm Hg):	759.9	Temperature (deg K):	299.6
Corrected riessure (illiin rig).	755.5	remperature (deg it).	233.0

Calibration Orifice

Model:	TE-5025	Slope:	1.29575
Serial No.:	3465	Intercept:	-0.01116
Calibration Due Date:	23-Sep-21	Corr. Coeff:	0.99995

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.26	0.873	35.6	35.52
2	2.32	1.181	39.0	38.85
3	3.28	1.402	41.5	41.34
4	3.82	1.512	43.0	42.83
5	4.34	1.612	43.8	43.69

Sampler Calibration Relationship (Qa on x-axis, IC on y-axis)

Checked by:

m=	11.2021	b=	25.7046	Corr. Coeff=	0.9993
Sampl	er set point(SSP)	39	CFM		
		С	alculations		
Qstd = 1/m[Sqrt]	(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/P)]	'std)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard	flow rate		Tav = average temperature		
IC = corrected c	hart response		Pav = average pressure		
I = actual chart i	response				
m = calibrator (Ostd slope				
b = calibrator Q	estd intercept				
Ta = actual temp	perature during calibration (de	eg K)			
Pa = actual pres	sure during calibration (mm I	Hg)			
Tstd = 298 deg	K				
Pstd = 760 mm	Нg				
For subsequent	calculation of sampler flow:				
(1.21*m+b)/[Sq	rt(298/Tav)(Pav/760)]				
	à.				

Date:

05-May-2021



創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	Fanling Government School	Site ID:	A20	Date:	17-May-2021
Serial No:	1050	Model:	TE-5170X	Operator:	Casey Lau

Ambient Condition

Corrected Pressure (mm Hg):	757.4	Temperature (deg K):	303.4
Corroctou i roccuro (illin rig):	, , ,	i omporataro (aog 1t).	505.1

Calibration Orifice

Model:	TE-5025	Slope:	1.29575
Serial No.:	3465	Intercept:	-0.01116
Calibration Due Date:	23-Sep-21	Corr. Coeff:	0.99995

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis	
Test #	(in)	(m3/min)	(chart)	(corrected)	
1	1.28	0.871	36.3	35.95	
2	2.35	1.179	39.7	39.31	
3	3.32	1.400	42.3	41.83	
4	3.86	1.510	43.8	43.34	
5	4.40	1.610	44.6	44.12	

Sampler Calibration Relationship (Qa on x-axis, IC on y-axis)

Checked by:

m=	11.2814	b=	26.0869	Corr. Coeff=	0.9991
Sampler set point(SSP)		40	CFM		
		С	alculations		
Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope			
IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]			b = sampler intercept		
L 1 \	/\ /1		I = chart response		
Qstd = standard flow rate			Tav = average temperature		
IC = corrected chart response			Pav = average pressure		
I = actual chart	response				
m = calibrator (Qstd slope				
b = calibrator Q	Ostd intercept				
Ta = actual tem	perature during calibration (de	eg K)			
Pa = actual pres	sure during calibration (mm F	łg)			
Tstd = 298 deg	K				
Pstd = 760 mm	Hg				
For subsequent	calculation of sampler flow:				
(1.21*m+b)/[Sq	rt(298/Tav)(Pav/760)]				
	21				

Date:

17-May-2021





TE-5025A

Vol. Init

(m3)

RECALIBRATION DUE DATE:

September 23, 2021

Certificate of Calibration

Calibration Certification Information

Cal. Date: September 23, 2020

Run

Rootsmeter S/N: 438320

Ta: 295 Pa: 751.1 °K mm Hg

Operator: Jim Tisch Calibration Model #:

Calibrator S/N: 3465

	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	2	1	1.4350	3.3	2.00
1	4	1	1.0200	6.4	4.00
1	6	1	0.9050	8.0	5.00
1	8	1	0.8650	8.8	5.50

		Data Tabula	ion		
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$ (y-axis)	Va	Qa (x-axis)	√∆H(Ta/Pa) (y-axis)
0.9939	0.6926	1.4130	0.9956	0.6938	0.8863
0.9898	0.9704	1.9983	0.9915	0.9720	1.2534
0.9877	1.0914	2.2342	0.9893	1.0932	1.4014
0.9866	1.1406	2.3432	0.9883	1.1425	1.4698
0.9813	1.3744	2.8260	0.9830	1.3767	1.7726
	m=	2.06928		m=	1.29575
QSTD	b=	-0.01779	QA	b=	-0.01116
	r=	0.99995		r=	0.99995

	Calculation	S	
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)
Qstd=	Vstd/ΔTime	Qa=	Va/ΔTime
	For subsequent flow rat	e calculatio	ns:
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrato	r manometer reading (in H2O)
ΔP: rootsmet	er manometer reading (mm Hg)
Ta: actual abs	solute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue village of Cleves, OH 45002

www.tisch-env.com
TOLL FREE: (877)263-7610

FAX: (513)467-9009









Tel. : (852) 2698 68 Fax.: (852) 2698 93

Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Repor

Verification Test Date: 28-Jun-20 to 5-Jul-20

Next Verification Test Date: 5-Jul-21
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 761173
Our Report Refrence No. RPT-20-HVS-002-R1

Standard Equipment Information			
Verification Equipment Type		Tisch's	Tish HVS
verification Equipment Type		TSP HVS	Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	3702	1050
Last Calibration Date		15-Jun-20	10-Oct-20
Next Calibration Date		14-Sep-20	11-Oct-21

Verification	Date		Time		K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)		
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis		
1	28/6/2020	1128.37	1131.37	180.00	0.00143	14.73	2652	R200550/1	21		
2	28/6/2020	1152.37	1155.37	180.00	0.00175	8.55	1539	R200550/3	15		
3	28/6/2020	1176.38	1179.38	180.00	0.00136	11.02	1983	R200550/2	15		
4	5/7/2020	1200.39	1203.39	180.00	0.00171	12.85	2313	R200592/1	22		
5	5/7/2020	1224.40	1227.40	180.00	0.00205	7.82	1407	R200592/2	16		
6	5/7/2020	1248.41	1251.41	180.00	0.00208	7.22	1299	R200592/3	15		
					0.00173	1/					

1.7

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

By Linear Regression of y on x:

slope, mh= 0.9050 intercept,ch= 7.9538

*Correlation Coefficient,R: 0.8348


Verification Test Result: Strong Correlation, Results were accepted.

 $\ ^{*}$ If the Correlation Coefficient, R is <0.5. Checking and

Re-verification are required

Verified By: Technical Manager

Date: 05-07-2020

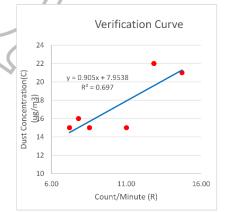









Tel.: (852) 2698 6833 Fax: (852) 2698 9383

Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 28-Jun-20 to 5-Jul-20

Next Verification Test Date: 5-Jul-21
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 761174
Our Report Refrence No. RPT-20-HVS-001-R1

Standard Equipment Information			
Verification Equipment Type		Tisch's TSP HVS	Tish HVS Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	3702	1050
Last Calibration Date		15-Jun-20	10-Oct-20
Next Calibration Date		14-Sep-20	11-Oct-21

Verification	Date		Time		K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)	
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis	
1	28/6/2020	1128.37	1131.37	180.00	0.00108	19.37	3486	R200550/1	21	
2	28/6/2020	1152.37	1155.37	180.00	0.00123	12.20	2196	R200550/3	15	
3	28/6/2020	1176.38	1179.38	180.00	0.00111	13.52	2433	R200550/2	15	
4	5/7/2020	1200.39	1203.39	180.00	0.00103	21.28	3831	R200592/1	22	
5	5/7/2020	1224.40	1227.40	180.00	0.00095	16.87	3036	R200592/2	16	
6	5/7/2020	1248.41	1251.41	180.00	0.00090	16.63	2994	R200592/3	15	
					0.00105	1				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

By Linear Regression of y on x:

slope, mh= 0.8379 intercept,ch= 3.3876

*Correlation Coefficient,R= 0.8776

Verification Test Result: <u>Strong Correlation, Results were accepted.</u>


* If the Correlation Coefficient, R is <0.5. Checking and

Re-verification are required

Verified By:

Technical Manager

Date: 05-07-2020

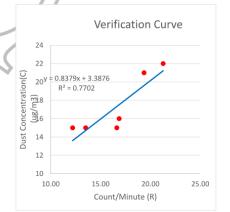

The copyright of this document is owned by Acuity Sustainability Consulting Limited. It may not be reproduced except with prior written approval from the Company.

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX G: THE CERTIFICATION OF LABORATORY CERTIFICATE





Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界獎涌永業街1-3號忠信針織中心11樓

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 為香港認可處執行機關根據認可諮詢委員會建議而接受的

HOKLAS Accredited Laboratory 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO / IEC 17025 : 2005 - General requirements for the competence 此實驗所符合ISO / IEC 17025: 2005 - (测試及校正實驗所能力的通用規定)所訂的要求 of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as 獲認可進行截於香港實驗所認可計劃(認可實驗所名冊)內下達測試類別中的指定 listed in the HOKLAS Directory of Accredited Laboratories within the test category of 測試或校正工作

Environmental Testing 環境測試

This laboratory is accredited in accordance with the recognised international Standard ISO / IEC 17025 : 2005. 本實驗所乃根據公認的國際標準 ISO / IEC 17025 : 2005 獲得認可。 This accreditation demonstrates technical competence for a defined scope and the operation of a laboratory 這項認可資格淡示在指定範疇所需的技術能力及實驗所質量管理關系的運作 quality management system (see joint IAF-ILAC-ISO Communiqué). (見國際認可論壇、國際實驗所認可含作組織及國際標準化組織的聯合公配)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 香港認可處根據認可處執行機關的權限在此蓋上通用印章

CHAN Sing Sing, Terence, Executive Administrator

執行幹事 陳成城 Issue Date: 5 May 2009

簽發日期:二零零九年五月五日

Registration Number : NOMAS 066 註冊號碼:

Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日

This certificate is issued subject to the terms and conditions laid down by HKAS 本證書按照香港超可應訂立的模數及條件發出

L 000552





Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Lot 12, Tam Kon Shan Road, North Tsing Yi, New Territories, Hong Kong 香港新界青衣北担杆山路12路段

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 在認可諮詢委員會的建議下獲香港認可處執行機關接受為

> **HOKLAS** Accredited Laboratory 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO/IEC 17025:2005 and it has been accredited for performing specific tests or calibrations as listed in the scope of accreditation within the test category of

Environmental Testing

此實驗所符合ISO/IEC 17025:2005所訂的要求 並獲認可進行載於認可範圍內下述測試類別中的指定測試或校正工作

環境測試

This accreditation to ISO/IEC 17025:2005 demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2005 的認可責格證明此實驗所具備指定範疇內所須的技術能力並實施一套實驗所質量管理體系(見圖際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公發)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

WONG Wang-wah, Executive Administrator

執行幹事 黃宏華 Issue Date: 16 July 2014

簽發日期:二零一四年七月十六日

Registration Number: HOKLAS 241

註冊號碼:

Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

L 001195


This certificate is issued subject to the terms and conditions laid down by HKAS 本語書按照香港認可處訂立的複數及條件發出

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX H: LOCATION PLAN OF AIR QUALITY MONITORING STATION



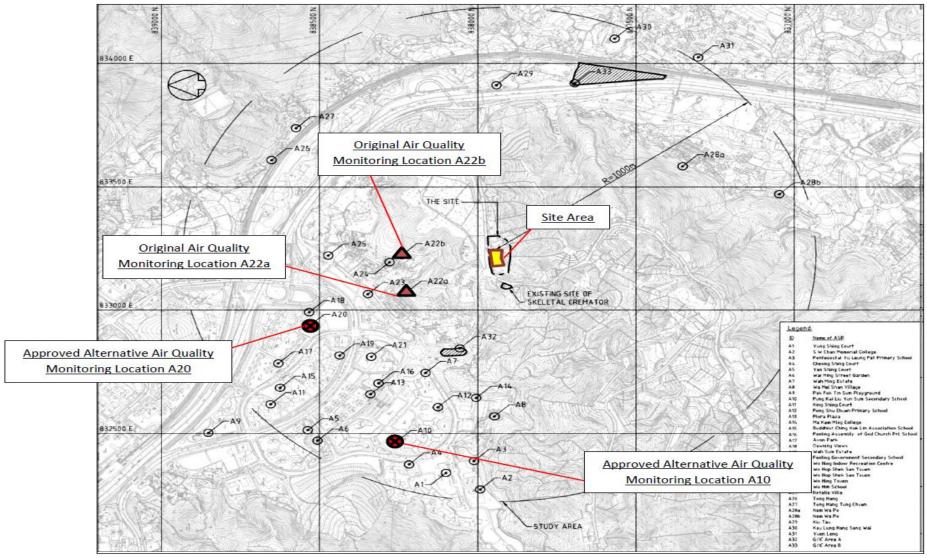

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX I: AIR QUALITY MONITORING DATA




The Summary of 1-hour TSP Concentration (µg/m³) at A10

Data	Weather	Sampling	Sampling	Sampling	Reading (1)	Reading (2)	Reading (3)	Average
Date	Weather	Time (1)	Time (2)	Time (3)	μg/m³	μg/m³	μg/m³	μg/m³
5/5/2021	Sunny	10:30	11:30	12:30	58	53	47	53
11/5/2021	Sunny	10:44	11:44	12:44	56	59	51	55
17/5/2021	Sunny	10:32	11:32	12:32	53	56	50	53
22/5/2021	Sunny	9:55	10:55	11:55	51	48	54	51
27/5/2021	Sunny	10:25	11:25	12:25	57	55	58	57

Average 1-hour TSP: 54

Max.: 59

Min.: 47

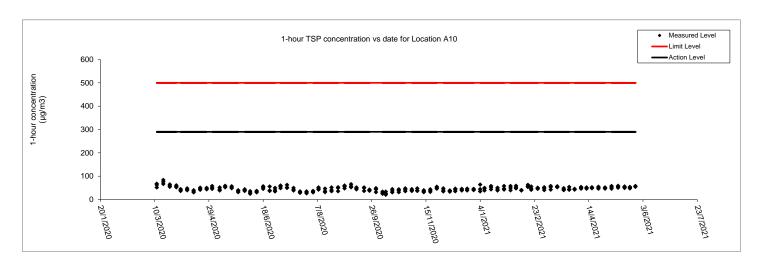




The Summary of 1-hour TSP Concentration ($\mu g/m^3$) at A20

Date	Weather	Sampling Time (1)	Sampling Time (2)	Sampling Time (3)	Reading (1) μg/m³	Reading (2) μg/m³	Reading (3) μg/m³	Average μg/m³
5/5/2021	Sunny	11:10	12:10	13:10	54	51	50	52
11/5/2021	Sunny	11:21	12:21	13:21	50	48	55	51
17/5/2021	Sunny	11:07	12:07	13:07	52	58	51	54
22/5/2021	Sunny	10:21	11:21	12:21	47	45	52	48
27/5/2021	Sunny	10:59	11:59	12:59	53	58	49	53
5/5/2021	Sunny	11:10	12:10	13:10	54	51	50	52

Average 1-hour TSP: 52

Max.: 58

Min.: 45

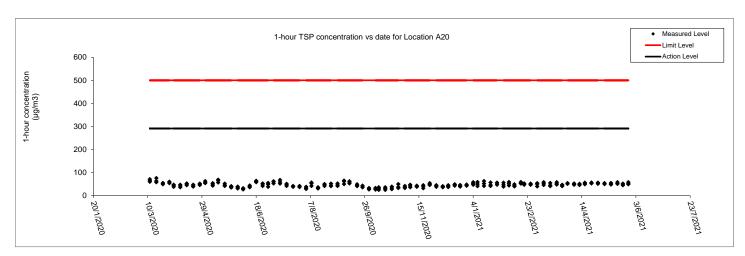



Slope =

Intercept =

13.3985

22.9716

5-May-21


18-May-21

Date of Calibration:

Calibration due date:

					Date of	Calibration:	17-M	ay-21	Slope =	13.2873					
					Calibrati	on due date:	30-May-21		Intercept =	22.3161					
Start Date	Weather Condition	E	lapse Tin	ne	Charl Reading			Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter W	eight (g)	Particulate weight	Conc.
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m³/min)	(m³)	Initial	Final	(g)	(μg/m³)
05/05/2021	Sunny	7253.4	7277.4	1440.0	40	41	40.5	26.6	759.7	1.30	1870	2.7639	2.8812	0.1173	63
11/05/2021	Sunny	7277.4	7301.4	1440.0	40	40	40.0	29.2	756.3	1.24	1779	2.7628	2.8076	0.0448	25
17/05/2021	Sunny	7301.8	7325.8	1440.0	39	40	39.5	30.4	757.4	1.26	1809	2.7516	2.7801	0.0285	16
22/05/2021	Sunny	7325.8	7349.8	1440.0	39	39	39.0	30.5	755.3	1.21	1743	2.757	2.8025	0.0455	26
27/05/2021	Sunny	7349.8	7373.8	1440.0	40	40	40.0	30.3	757.2	1.29	1863	2.7508	2.7823	0.0315	17



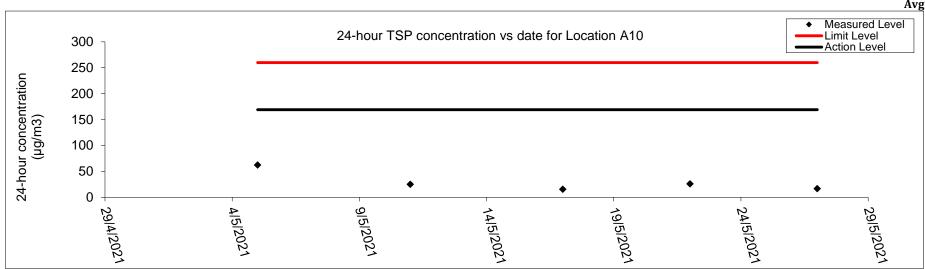



Slope =

Intercept =

11.2021

25.7046

5-May-21


18-May-21

Date of Calibration:

Calibration due date:

					Date of (Calibration:	17-M	ay-21	Slope =	11.2814					
					Calibratio	n due date:	30-May-21		Intercept =	26.0869					
Start Date	Weather Condition	E	lapse Tin	ie	Chart Reading			Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter W	eight (g)	Particulate weight	Conc.
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m³/min)	(m³)	Initial	Final	(g)	(μg/m³)
05/05/2021	Sunny	7518.1	7542.1	1440.0	40	41	40.5	26.6	759.7	1.31	1886	2.7368	2.8365	0.0997	53
11/05/2021	Sunny	7542.1	7566.1	1440.0	40	40	40.0	29.2	756.3	1.23	1777	2.7599	2.7954	0.0355	20
17/05/2021	Sunny	7566.4	7590.4	1440.0	39	39	39.0	30.4	757.4	1.10	1587	2.7465	2.7716	0.0251	16
22/05/2021	Sunny	7590.4	7614.4	1440.0	39	40	39.5	30.5	755.3	1.14	1635	2.7655	2.7999	0.0344	21
27/05/2021	Sunny	7614.4	7638.4	1440.0	39	39	39.0	30.3	757.2	1.10	1586	2.7464	2.7625	0.0161	10

Min: 10 Max: 53 Avg: 24

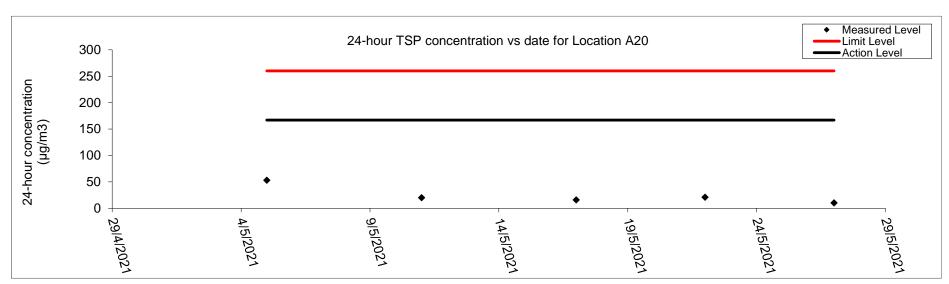




Wind direction data for 05, 11, 17, 22 and 27 May 2021

A. 05/05/2021:

Wind Direction:



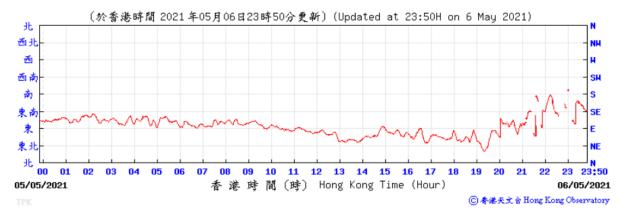



B. 11/05/2021:

Wind Direction:









C. 17/05/2021:

Wind Direction:

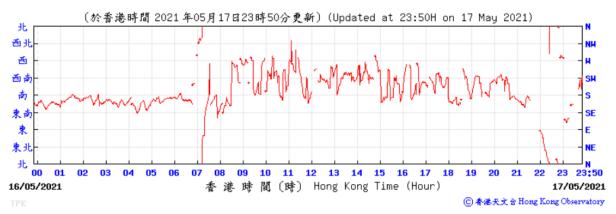


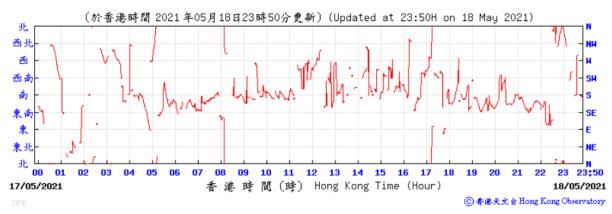




D. 22/05/2021:

Wind Direction:

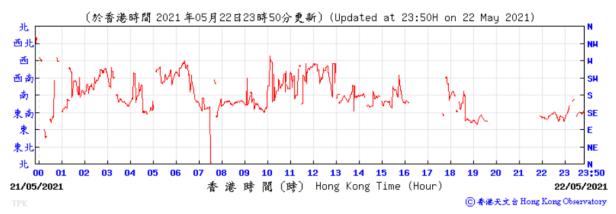


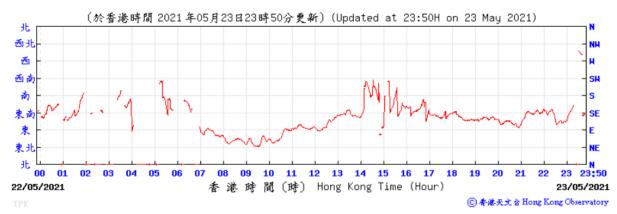



E. 27/05/2021

Wind Direction:

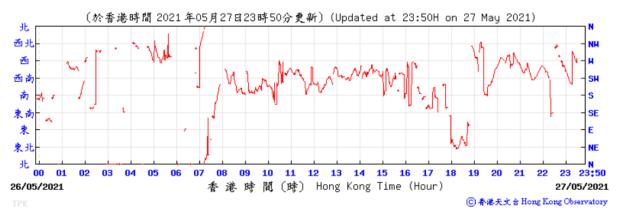






Wind speed data for 05, 11, 17, 22 and 27 May 2021

A. 05/05/2021:

Wind Speed:

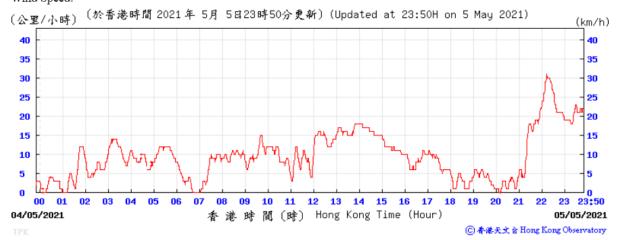







B. 11/05/2021:



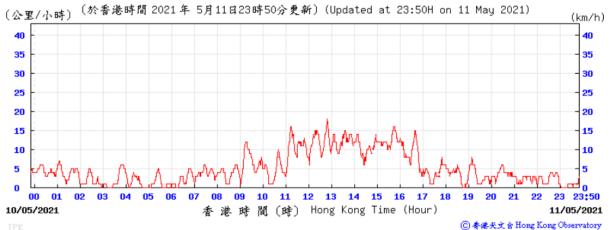


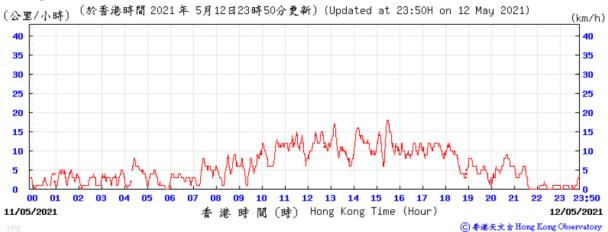




C. 17/05/2021:

Wind Speed:

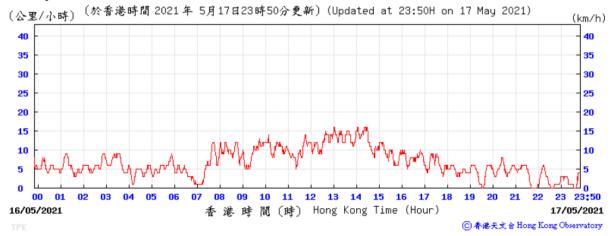


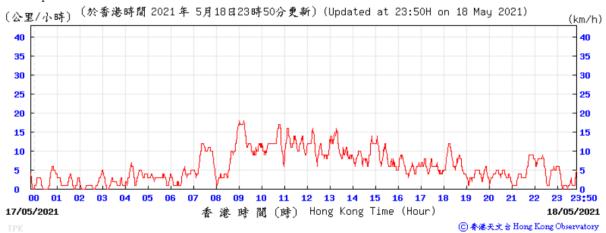




D. 22/05/2021:



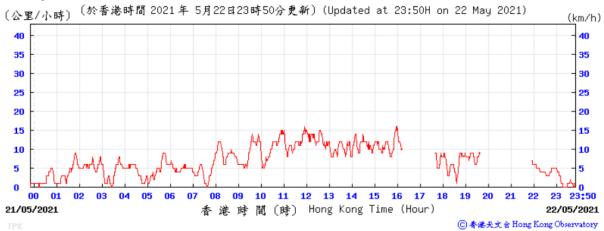


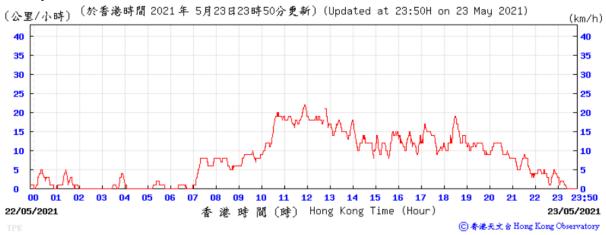



E. 27/05/2021



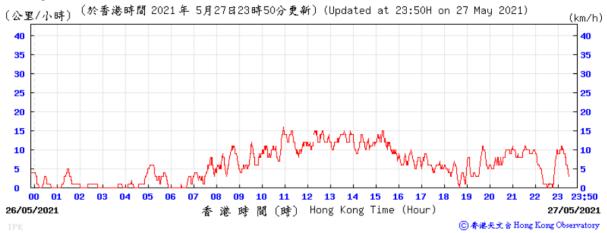



Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX J: WASTE FLOW TABLE



		Actual Qua	ntities of Ine	rt C&D Mateı	rials Generat	ed Monthly	Actual	Quantities of	C&D Wastes	Generated N	Ionthly
Reporting Month	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper / cardboard packaging	Plastics (see Note)	Chemical Waste	Others, e.g. general refuse
	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)	(in ,000kg)
March 2020	1.35	0	0	0	1.35	0	0	0	0	0	0
April 2020	1472.9	0	614.00	0	855.61	0	0	0	0	0	3.29
May 2020	213.75	0	0	0	205.94	0	0	0	0	0	7.81
June 2020	1.86	0	0	0	0	0	0	0	0	0	1.86
July 2020	4.95	0	0	0	0	0	0	0	0	0	4.95
August 2020	308.99	0	0	0	306.38	0	0	0	0	0	2.61
September 2020	31.11	0	0	0	22.38	0	0	0	0	0	8.73
October 2020	18.08	0	0	0	14.33	0	0	0	0	0	3.75
November 2020	1.42	0	0	0	0	0	0	0	0	0	1.42
December 2020	16.99	0	0	0	14.88	0	0	0	0	0	2.11

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



January 2021	25.87	0	0	0	22.12	0	0	0	0	0	3.75
February 2021	2.00	0	0	0	0	0	0	0	0	0	2.00
March 2021	3.79	0	0	0	0	0	0	0	0	0	3.79
April 2021	7.40	0	0	0	0	0	0	0	0	0	7.40
May 2021	8.30	0	0	0	0	0	0	0	0	0	8.30

Remarks: The major excavation works were conducted in April and May 2020, approximately 1675.55 tonnes of inert excavated materials were generated. 614 tonnes of excavated materials were stored in the material storage area for the subsequent backfilling. Due the limited space and the construction of basement and other substructure works, the remaining 1061.55 tonnes of excavated material were delivered to public fill reception facilities. Some minor excavation works may be conducted in the later work processes.

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15 Waste to Landfill (May 2021):



Facility 2	Date of transactio n	Vehicle No.2	Account No. 2	Chit No. 2	Time-in2	Time-out?	Waste depth (meter)	Weight- in (tonne)	out	Net weight (tonne)
NENT	07/05/21	LA5*81	7032841	22174857	12:22	12:41	1.13	17.58	15.71	1.87
NENT	11/05/21	LA5*81	7032841	22174858	11:07	11:32	1.38	17.92	15.75	2.17
NENT	18/05/21	LA5*81	7032841	22174859	13:51	14:23	1.25	17.69	15.81	1.88
NENT	25/05/21	LA5*81	7032841	22174860	16:52	17:11	1.08	18.09	15.71	2.38
								Grand	Total:	8.3



	NENT LA	GOVERNMENT (ANDFILL TRANS 行政區政府新界)	SACTION	RECORD	
fate: 日期	07/05/21	Veh. Reg. Mark: 車牌號碼	LA5581	Transaction Ref. I 備考號碼	No: 4552646
Time in: 進入時間	12:22	Time out: 離開時間	12:41	Billing A/C No: 帳戶編號	7032841
In Weight(tonne); 入載直量(公噸)	17.58	Out Weight(tonne): 出載重量(公噸)	15.71	Chit No.: 載運入帳票編號	22174857
Estimated Net Wei 淨重北率	ght /GVW Ratio: 8%	Waste dop in (met 廢物深度(米)	er): 1.13	Net Waste Load (廢物淨重量(公	
		CHARGE RE 收費記録		(for reference only 〔僅供參考〕)
Charge Load (ton) 收費重量(公項) Remarks: 備註	1,9	181	Charse 收賽(i	e Amount (HK\$); 陪弊)	HK\$380.0
收養重量(公頃) Remarks: 備註 The charge record sho	1.9 wn on this Slip is i	ndicative of the charge crasscrion. 等以日结四色准。	收賽(港幣)	
吹舊重量(公項) Remarks: 備註 The charge record sho would be the actual/fir	1.9 wn on this Slip is i	ransaction. 費以月結單爲準。	收賽(港幣)	
吹賽重量(公項) Remarks: 備註 The charge record sho would be the acrual/fit 所示的攻對記錄只信 Account Status Al: No Eilling Account A2: Account Cuernus A3: Account Suspended	1.9 wn on this Slip is i	rantachun	收費G only. The char only and	港幣)	
Po 費重量(公項) Remarks: 個註 The charge record sho would be the actual/fit 所示的攻對記錄只信 Account Status A1: No Eilling Account A2: Account Overdue A3: Account Supended A7: Account Revoked	1.9 wn on this Slip is i	7:Insaction. 野以月結軍為達。 <u>巨口狀況</u> AL: 大有八 A2: 戸口 A3: 戸口	收費(i only. The char only. The char offina offin	港幣)	
P. 改善量(公項) Remarks: 備註 The charge record sho would be the actal/fit 所示的改赞記錄只是 Account Status A!: No Eilling Account A2: Account Suspended A4: Account Charles A3: Account Suspended A4: Account Charles BC: Charathe	1,9 wn on this Slip is i al charge for the n 供参考、正式收養	* Asacton. 費以月結取為準。 	收數() conly. The char lip 1 lip 4 lip 1 lip	感樂) ge amount as shown (
P. 改善重(公項) Remarks: 備註 The charge record sho would be the actual/fit fr开心攻背記錄只是 Account Status Al: No Filling Account A2: Account Overdue A3: Account Suspended A4: Account Revoked Reasons For Rejecting B1: Chavitable Material B2: No Vaid Chit B3: Urematched Chit Infe B4: Others	1.9 wn on this Slip is it all charge for the n 共参考、正式收養	**	收數() only. The char will purply with the char will purply with the char will purply with the char with th	感樂) ge amount as shown (
攻舊重量(公頃) Remarks: 備註	1.9 wn on this Slip is it all charge for the next was supported by 正式收费 writing the state of	# A	收裝() only. The char well and the second of the second o	感樂) ge amount as shown (

THE GOVERNMENT OF THE HKSAR NENT LANDFILL TRANSACTION RECORD 香港特別行政區政府新界東北堆填區交收記錄

1	Date: 日斯	11/05/21	Veh. Reg. Mark: 車牌號碼	LA55B1	Transaction Ref. No: 備考號碼	4555719
	Time in: 進入時間	11:07	Time out: 離期時間	11:32	Billing A/C No: 帳戶編號	7032841
	In Weight(tonne): 入載重量(公順)	17.92	Out Weight(;onne); 出載重量(公噸)	15.75	Chit No.: 載運入帳票編號	22174858

Estimated Net Weight GVW Ratio:	Waste depth (meter):	Net Waste Load (torne)
淨重比率 9%	廢物深度(米) 1.38	廢物淨重量(公噸) 2.17

CHARGE RECORD (for reference only) [僅供參考]

收費記錄

Charge Amount (HK\$): HK\$440.0 收費(港幣)

Remarks: 備註

Charge Load (tonne):

收費重量(公噸)

The charge record shown on this Slip is indicative of the charge only. The charge amount as shown on the monthly bill would be the actual/final charge for the transaction.

所示的收費記錄只供參考,正式收費以月結單爲準

Account Status 戶口狀況 A1: No Billing Account Al: 未有入帳戶口 A2 : Account Overdue A2:戶口過期未繳費 A3 : Account Suspended A3:戶口已吊銷 A4 : Account Revoked A4:戶口已撤銷 Reasons For Rejecting 拒進原因一覽表 R1: Unsuitable Material R1:物料不符合要求 R2 ; No Valid Chit R3: Unmatched Chit Information R3: 載運入帳票資料不符 R4: 其他

Recommended Disposal Facility For Construction Waste 介绍体等原物能置設施

D1 ; Landfill D2 : Sorting Facility D3 : Public Fill Reception Facility D2: 简選分類設施 D3:公眾填料接收設施

Waste Hauler's Copy 運輸商副本

Enquiry phone: 26746505 查謝整話





THE GOVERNMENT OF THE HKSAR NENT LANDFILL TRANSACTION RECORD 香港特別行政區政府新界東北堆填區交收記錄

Estimated Net Wei 淨重比率	elit /GVW Ratio: 10%	Waste depth (meta 廢物深度(米)	er): 1.08	Net Waste Load (tor 廢物淨重量(公噸)	
In Weight(tonne): 入載重量(公噸)	18.09	Out Weight(tonne): 出載重量(公噸)	15.71	Chit No.: 載運入帳票編號	22174860
Time in: 進入時間	16:52	Time out: 離開時間	17:11	Billing A/C No: 帳戶編號	7032841
Date: 日期	25/05/21	Veh. Reg. Mark: 車牌號碼	LA5581	Transaction Ref. No: 備考號碼	4569494

CHARGE RECORD (for reference only)

收費記錄

【僅供参考】

Charge Amount (HK\$): 收費(港幣)

HK\$480.0

Remarks: 備註

Charge Load (tonne):

收費重量(公噸)

The charge record shown on this Sip is indicative of the charge only. The charge amount as shown on the monthly bill would be the actual/final charge for the transaction.

所示的收費記錄只供參考,正式收費以月結單爲準。

A1 : No Billing Account A2 : Account Overdue A3 : Account Suspended A4 : Account Revoked

Account Status

A1:未有人帳戶口 A2:戶口過期未繳費 A3:戶口已吊銷 A4:戶口已撤銷

| 後級場際: 22174860 | Did No. | Did N

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX K: SITE INSPECTION PROFORMA



Unit 1908, Nos. 301 305 Castle Prax Road, Kwai Chung, N 7

Inspe	ction Date	e: 5/5/2021	WEEKLIEN	Inspected by:		ET:	Shinny	11		AR:		
Inspe	ction Tim	e: 10 100				actor:	+ i /	Yuen		EC:	/	
Weat	her						2			_		
Cond	ition	☑ Sunny	☐ Fine	☐ Overcast	☐ Drizzle		□ Rai	in	□ Sto	orm	☐ Hazy	v
Temp	erature	29.4 °C			Humidity		☐ His	gh	□/Mc	oderate	□ Low	
Wind		□ Calm	Light	☐ Breeze	☐ Strong				/			
	Enviro	nmental Mitigation	Measures			N/A*	N/O*	Yes*	No*		Photo/Remai	rks
1.00	Air (Co	onstruction Phase)		***************************************		1		Anna ann an Anna ann ann an Anna				
1.01	Vehicle	washing facilities (in	ncluding a high pres	sure water jet) were	provided at					T		
1.01	every di	scernible or designat	ed vehicle exit point					Д	Ш	-		
1.02	Road be	etween the washing	facilities and the ex	it point is paved wit	h concrete,			_				
1.02	bitumine	ous or hardcore mate	rial.			П			Ш	-		-
	Every m	nain haul road is pay	ved with concrete, b	ituminous hardcore r	naterials or							
1.03	metal pla	ates, and kept clear of	f dusty materials. Or	unpaved haul roads ar	nd areas are			Ø		_		
	sprayed	with water to keep th	e entire road surface	wet.				/				
	Stockpil	e of dusty material in	cluding demolished	items is either:								
	a) cove	red entirely by imper	vious sheeting, or									
1.04	b) place	ed in an area sheltered	d on the top and the t	hree sides, or								
	c) spray	ed with water or a d	ust suppression chen	nical so as to maintain	n the entire							
	surfa	ce wet.			-							
	Exposed	earth is properly trea	ted by compaction, h	ydroseeding, vegetati	on planting		,			The	e construction	nork
1.05	or seatin	g with latex, vinyl, b	oitumen within six m	onths after the last co	onstruction	Ø				h	as not be	en
	activity of	on the site or part of t	he site where the exp	oosed earth lies.							Completed	-
1.06	Water is	sprayed to all dusty r	naterials before load	ing or transfer operati	on			П				
					OII.		Ш			_		-
1.07	Any deb	oris is covered entir	ely by impervious	sheeting or stored in	n a debris							
	collection	n area sheltered on th	e top and the three s	ides.				4	ш			
1.08	Water is :	sprayed to debris before	ore it is dumped into	a chute.		П			П			
								7				
1.09				are covered with ta				N				
				of the sides and tailbe								
				for uprooting of trees,				_/				
1 10			boulders, pole, pille	ars before, during and	d after the			Ø				
	operation											
1.11			erative to avoid dust	generation and disper	sion to the			\square				
-		ing environment.					hanned .	7				
2.00	Noise (Co	onstruction Phase)										



Cond Link No. 301 30's Cardio Re a Road Kana Chang, N. F.

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
2.01	Only well-maintained plant is operated on site and the plant should be regularly serviced during the construction works.			Ø		
2.02	Plant used intermittently is turned off or throttled down when not in active use.			Ø		
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			Ø		
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			Ø		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			Ø		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.	P				No excupated mes story
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			ď		
4.02	A billing account with EPD for disposal of construction waste is obtained.			Þ		
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Ø		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			P/		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ó		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø		
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			Ø		



Unit 1908, Nos. 301-305 Castre Peak Road. K.wai (nong. N.*

O. 2333-6823 | F. 2333-1316 | E. general@acutyhk.com | www.acutyhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			Ø		
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			Ø		-
4.10	Are appropriate measures to minimise windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers adopted?			Ø		
4.11	Is recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites) implemented?			Ø		
4.12	Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.			Ø		
4.13	Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separately labelled bins are provided to help segregate this waste from other general refuse generated by the work force.			Ø		
4.14	Are C&D materials reused when possible to reduce the amount of C&D material/waste?			Ø		
4.15	Are wood, steel and other metals separated for reuse and / or recycling prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill?			ď		
4.16	Minimise the potential for damage or contamination of construction material by having proper storage and site practices.			Ø		
4.17	Plan and stock construction materials carefully to minimise the amount of surplus materials.			Ø		
4.18	Rock and soil generated from excavation are reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.	Ø				No excaveted natural
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			Ø		
4.20	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) is directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites.			ď		
4.21	Are individuals or companies who deliver public fill to public filling areas obtained dumping licences?			Þ		



Quest justice Nov. 2012. 10/per entre de de Roud este el fermille. No la companya de la companya del companya de la companya del companya de la companya del la companya de la companya de

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			Ø		
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Ø		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			Þ		
	Chemical Waste					
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			P		
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			ď		
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			Ø		
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			d		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			ď		
5.00	Landscape and Visual (Construction Phase)					
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Ø		construction vale
5.02	Are site offices and the construction yard decommissioned after construction?	Ø				has not been completed
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			Ø		



Unit 1908, Nos. 301 305 Castle Peak Road, Kwai Chung, N. O. 2333 6823 F. 2333 1316 | F. gengraligiac untylik comp. J. 2004, p. 1904, p. 2004

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?			ď		
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			P		
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?	Ø				The constructing work has not been completel
5.08	Are construction lights oriented away from the viewing location of VSRs?		Ø			Toutest
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?		Ø			
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			Þ		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		And the second s
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				he mostly has had been controll
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	Ø				No planting month
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Ø				All thee plant with has been completed
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			Ø		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			ď		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.	Ø				not been constructed
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.	Ø				The chimmey has not been constructed



Impose that 301 305 Cactories 80 at an at 1991 Note

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			Ø		
5.21	Are silting traps installed to minimize silting to streams?			Ø		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	Ø				No planting work
5 23	Is amenity planting for open spaces included in the Project?	Ø				No planting north
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	Ø				No plantie monte
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Ø				No plenting work
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			Ø		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.			Ø		
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.			Ø		
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are			/	/	
	provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			Ø		
6.04				<u>Д</u>		No exavetion work
6.04	Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during					No exacetion work The constructs now has not been completed
	Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the					No exacetion work The constructs now has not been completed.
6.05	Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope					No exavetion work The constructs nove has not been completed. No exavetion nork.



Unit 1908, Nos. 301-305 Castle Peak Road, Kwar Chung, N. T O. 2333-6823 F. 2333-1316 F.E. generali@acuityhk.com F.w.w.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			Ø		
-						
6.10	Oil interceptor is provided in the drainage system and regularly emptied to				_	
0.10	prevent the release of oil and grease into the storm drainage system after			Д		
-	accidental spillage.					
6.11	Debris and rubbishes generated on site are collected, handled and disposed of			Ø		
	properly to avoid them entering the two streams.					
	All fuel tanks and storage areas are provided with locks and be sited on sealed			/		
6.12	areas, within bunds of a capacity equal to 110% of the storage capacity of the			ď		
	largest tank.					
6.13	Open storm water drains and culverts near the works area are covered to block the			\square		
	entrance of large debris and refuse.			<u> </u>		
	Portable chemical toilets handle the sewage from construction work force if the					
6.14	existing toilets in the Site are not adequate. Licensed contractors who are		d			
	responsible for appropriate disposal and maintenance of these facilities provide		لطر		Ш	
	appropriate and adequate portable toilets.					
	Sheet piling is provided at suitable location around the basement excavation to					
	reduce the effect of lowering the water table from any dewatering process. Any					1 a mande atta
6.15	discharge of groundwater pumped out from any dewatering process of the					No growduater
0.10	construction works is treated to comply with the standards set in the relevant				Ц	las genretto
	discharge licence prior discharge. No discharge of the groundwater is allowed into					
	the two streams.					
7.00	Ecology (Construction Phase)		-			
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop			_/		
7.01	Shek Cemetery.	Ц		u	ш	
7.02	Temporary accesses to the work sites are carefully planned and located to			_		
7.02	minimise disturbance caused to the streams and nearby habitats.			Д		-
7.03	Less or smaller construction plants are used to reduce disturbance to the nearby			_/		
7.03	habitats.		Ш	1	ЦΙ	Methodological State Sta
7.04	Vehicles and other plants are carefully maintained and properly used to minimise			7		
7.04	the chance for accidental spillage.			И	ш	
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up	_/				1, 21
7.05	before they can contaminate streams or groundwater.	\square				No spillages occurre
	Basement formation or any construction activities likely to pump out a large					No granduallo
7.06	quantity of groundwater are protected with sheet-piling at suitable locations	Ø				was remembed
	around the basement footprint, or by any like method.	/-)***
7.07	No groundwater is pumped back to the two stream courses to protect the natural	/				No graduata
7.07	integrity of the stream habitat and the associated organism.	1				non generated.
-						



Chart 1908 No. 131 1014 Anni-Peak Rollad Kiwa Chang, No. 1 Cr. 2333 6823 F. 2313 1116 F. Eligania dei scultyfolician - www.scultyfik.com

1	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy but not around the trunk.			Ø		
7.09	Works beneath the tree canopy are avoided: If encroachment under the canopy area is unavoidable, adequate protections are provided to ensure no damage of any part of the tree would occur due to the encroachment.			ď		
7.10	Any tree transplanting and planting works are implemented by an approved Landscape Contractor. Quality control of the work is undertaken by a qualified Landscape Architect through site inspections and approval of works.			Ø		
7.11	Construction works are restricted within works area which are clearly defined.			Ø		
7.12	Woodland or other habitats that are affected by the construction works are well-defined and minimised.			Ø		
7.13	Human inference to habitats beyond the site boundary and habitats proposed to be retained are avoided by providing temporary barricades.			Ø		
7.14	Works area is reinstated immediately after completion of the construction.	Ø				The confluethy work has here been completed
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control measures are provided in order to protect nearby habitats.			Ø		
7.16	Trees requiring transplantation or protection are identified based on the information illustrated in the Tree Survey Report.			Ø		
7.17	Is layout of the Project carefully designed to avoid or minimize the area of habitat loss and the numbers of trees to be felled?			Ø		
7.18	All trees are preserved as far as possible, especially species of conservation concern. Recommendations provided in the Tree Survey Report to mitigate impacts on trees shall be followed.			Ø		
7.19	Disturbance to the two plant species of conservation concern, namely Aquilaria sinensis and Cibotium barometz, is avoided. Where removal of these species is unavoidable, it is recommended to transplant them to habitats with similar conditions. Following transplantation, regular monitoring of these plants is conducted by a suitable qualified botanist / horticulturist over a 12-month period;			Ø		
7.20	Compensatory planting of the felled trees follows the Technical Circular No. 3/2006 issued by ETWB.	Ø				No partiquent
7.21	The Site inside or in the proximity of the streams and nearby habitats is temporarily isolated, by placing of sandbags or silt curtains with lead edge at the bottom and properly supported props, to prevent adverse impacts on these areas.			Ø		



Unit 1908. Nos. 301-305 Castre Peak Road, Kwar Chung, N. T. C. 2333-6823 [F. 2333-1316 | E. generali@acuityhk.com | Aww.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			6		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			d		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			Ø		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			Ø		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			ď		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			Ø		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			Þ		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			Ø		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site wais.

Yes = Compilance

No = Non-compliance



and 1908 Nov. 301 301 decide their board and analytic of the second section of the con-

Remark / Follow up of Observation(s) and Non-compliance(s) of Last Weekly Site Inspection:								
Obsenqtia (s):	*							
Mil								
Reminden(S):								
NI								
Note: Figure 4,5 regarding clause at the entrance of the Site	3.6 of EP has	bren displayed.						
Signatures: ET Contractor's Representative Representative	Architect's Representative	IEC's Representative						
(Name: Thurst Kings) (Name: Rays (Name)	(Name: Liwowh)	(Name:)						



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST

Inspe	ction Dat	te: 12/5/202	1	Inspected by	y:	ET:	John	y Kn	ing	AR:	L, Wor	R_
Inspe	ction Tin	ne:			Contr	actor:	Mix	Wohe	_ 1	EC:	Hilton	Fam
Weat	her							,				
Condi	ition	☑ Sunny	☐ Fine	□ Overcast	□ Drizzle		□ Rai	n	□ Sto	rm	□ На	izy
Temp	erature	32.1 °C			Humidity		☐ Hig	;h	Ø Mo	oderate	□ Lo	w
Wind		□ Calm	Light	□ Breeze	☐ Strong							
	Enviro	onmental Mitigation	Measures	200		N/A*	N/O*	Yes*	No*		Photo/Rem	arks
1.00	Air (C	onstruction Phase)										
1.01		e washing facilities (discernible or designa		essure water jet) were	e provided at			Ø				
	Road b	between the washing	facilities and the	exit point is paved w	rith concrete,							
1.02	bitumii	nous or hardcore mate	erial.									
:	Every	main haul road is pa	aved with concrete,	bituminous hardcore	materials or							
1.03				or unpaved haul roads	and areas are			Image: section of the property o		-		
	-	d with water to keep t										
		ile of dusty material i		d items is either:								
	1 20	ered entirely by impe					_		_			
1.04		ced in an area sheltere				Ш	Ш	LX.		-		
			dust suppression ch	emical so as to mainta	ain the entire							
		face wet.								-4	2 4 . 14	7
1.05				, hydroseeding, vegeta							re construct	to such
1.05				months after the last	construction		Ш	Ш	Ш	-	has not	Slote 1
	activity	on the site or part of	the site where the e	xposed earth lies.			-					huica
1.06	Water i	s sprayed to all dusty	materials before loa	ading or transfer opera	ation.			Ø		-		
1.07	Any de	ebris is covered ent	irely by imperviou	s sheeting or stored	in a debris	П						
	collecti	on area sheltered on t	the top and the three	sides.				<u> </u>				
1.08	Water is	s sprayed to debris be	efore it is dumped in	to a chute.						-		
1.09	Vehicle	s for transporting d	usty materials/spoi	ls are covered with	tarpaulin or		П					
1.07	similar	material. The cover e	extends over the edg	es of the sides and tail	boards.			4		_		
	Water is	s sprayed immediately	y to the working are	a for uprooting of tree	es, shrubs, or							
1.10	vegetati	ion or the removal o	of boulders, pole, pi	Illars before, during a	and after the			Ø		-		
	operatio	on.										
1.11	Worker	s at all levels are co-o	perative to avoid du	st generation and disp	ersion to the							
		ding environment.						7				
2.00	Noise (Construction Phase))									



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
2.01	Only well-maintained plant is operated on site and the plant should be regularly serviced during the construction works			Ø		
2.02	Plant used intermittently is turned off or throttled down when not in active use.			9		
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			9		
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			Ø		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			Ø		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.	Ø				No excavated hes other
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			Ø		
4.02	A billing account with EPD for disposal of construction waste is obtained.			P		
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			P		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			þ		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			ď		
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.					



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			Ø		
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			7		
4.10	Are appropriate measures to minimise windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers adopted?			Ø		
4.11	Is recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites) implemented?			Ø		
4.12	Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.			Ø		
4.13	Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separately labelled bins are provided to help segregate this waste from other general refuse generated by the work force.			Ø		
4.14	Are C&D materials reused when possible to reduce the amount of C&D material/waste?			Ø		
4.15	Are wood, steel and other metals separated for reuse and / or recycling prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill?			Ø		
4.16	Minimise the potential for damage or contamination of construction material by having proper storage and site practices.			Ø		
4.17	Plan and stock construction materials carefully to minimise the amount of surplus materials.			Ø		
4.18	Rock and soil generated from excavation are reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.	ď				No excepted wateray Stand on site.
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			Ø		
4.20	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) is directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites.			ø		
4.21	Are individuals or companies who deliver public fill to public filling areas obtained dumping licences?			d		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as. steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			Ø		
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Ø		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			Ø		
	Chemical Waste					
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			P		
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			P		
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			Ø		
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Ø		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			Ø		
5.00	Landscape and Visual (Construction Phase)					
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Ø		
5.02	Are site offices and the construction yard decommissioned after construction?	Þ				Construction now Learn the fact been
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			Ø		
_						



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?			P		
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			P		
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?	9				his not been can pletel
5.08	Are construction lights oriented away from the viewing location of VSRs?		Ø			
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?		P			
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			Ø		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø		, par		been continued
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.					No planting mank
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Ø				All two plant work
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			P		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			9		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.	Þ				The chimnyles how hot both continued
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.	P				To chipme, her hat been constructed



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Bi-weekly checking would be performed on the nine Terminalian mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plant. 221 Are silting traps installed to minimize silting to streams? 322 Is the tree compensation to tree loss ratio at least 1.1 in term of quantity? 323 Is amenity planting for open spaces included in the Project? 324 Is sometify planting for open spaces included in the Project? 325 Is a menity planting or open spaces included in the Project? 326 Is some planting such as planting a roll of trees along the site boundary butting Kit Tau Road carried out? 327 Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the Woodland mix, comprising of tree seedlings and shalbs, are planted within the visual stage of site runnoff to the tree streets and woodlands are provided to meet the discharge standards set out in the reversal to the work streams is allowed. 328 Perimeter channels are provided to intercept atom runoff from outside the site. 329 The channels are constructed in advance of site formation works and earthworks. 320 Perimeter channels ar		Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect 523 Is amenity planting for open spaces included in the Project? 524 Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tan Road carriated ont? Woodland mix, comprising of tree seedlings and shrubs, are planted within the Woodland mix, comprising of tree seedlings and shrubs, are planted within the loss. 526 Woodland mix, comprising of tree seedlings and shrubs, are planted within the loss. 527 Is the 10th height headroom cremation plant room half-sunken to reduce the loss. 528 Is the 10th height headroom cremation plant room half-sunken to reduce the visual impact to pedestriam? 6400 Water Quality (Construction Phase) Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. 6402 Perimeter channels are provided to intercept storm runoff from outside the site. The channels are provided to intercept storm runoff from outside the site. The channels are provided to intercept storm runoff from outside the site. The channels are provided to intercept storm runoff from outside the site. The channels are provided to minimise soil excavation works and earthworks. 6403 provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. 6404 Works are carefully programmed to minimise soil excavation works during rainy seasons. 6405 Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. 6406 Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when ninistorms are likely to occur. 6407 Trenche excavation is avoided	5.20	within and outside the works area of the Project, or otherwise if the			d		
About 100 trees will be planted to compensate for the loss of \$4 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect 523 Is amenity planting for open spaces included in the Project? Is sercen planting such as planting a roll of trees along the site boundary buting Kiu Tau Road carried out? Woodland mix, comprising of tree seedlings and shrubs, are planted within the loss. Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss. Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians? Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.	5.21	Are silting traps installed to minimize silting to streams?			P		-
butting Kiu Tau Road carried out? Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss. 15.26 Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss. 15.26 Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians? 15.26 Water Quality (Construction Phase) Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. 15.27 Perimeter channels are constructed in advance of site formation works and earthworks. 15.28 Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. 15.29 Works are carefully programmed to minimise soil excavation works during rainy seasons. 16.30 Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. 16.30 Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. 16.31 Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. 16.32 Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.	5.22	About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the	P				No planty rock
butting Kiu Tau Road carried out? Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss. 1 st he 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians? 6.00 Water Quality (Construction Phase) Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Exposed soil surfaces are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	5.23	Is amenity planting for open spaces included in the Project?	Ø				No plantis not
Social Step	5.24		d				No planting nork
Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trenche excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of construction materials on site are covered with tarpaulin or Open stockpiles of constructi	5.25	Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree	₽				No plenting name
Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	5.26				d		
relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed. Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.00	Water Quality (Construction Phase)					
The channels are constructed in advance of site formation works and earthworks. Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.01	relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct					
provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO. Works are carefully programmed to minimise soil excavation works during rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.02				P		
rainy seasons. Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.03	provided to remove sand/silt particles from runoff to meet the requirements of the			Ø		
6.05 potential of soil erosion. Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.04		Ø				No excavation work
surfaces are protected when rainstorms are likely to occur. Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.05		Ø				The constructor work has not Soer Completed
necessary, these trenches are excavated and backfilled in short sections. Open stockpiles of construction materials on site are covered with tarpaulin or	6.06				Ø		
	6.07		Ø				No exametin not k
	6.08				P		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			Ø		
	Oil interceptor is provided in the drainage system and regularly emptied to					
6.10	prevent the release of oil and grease into the storm drainage system after		П		П	
	accidental spillage.	_	_		_	
	Debris and rubbishes generated on site are collected, handled and disposed of					
6.11	properly to avoid them entering the two streams.					
	All fuel tanks and storage areas are provided with locks and be sited on sealed					
6.12	areas, within bunds of a capacity equal to 110% of the storage capacity of the					
	largest tank.			/		
6.13	Open storm water drains and culverts near the works area are covered to block the			4		
0.13	entrance of large debris and refuse.	Ш	Ш		П	
	Portable chemical toilets handle the sewage from construction work force if the					
6.14	existing toilets in the Site are not adequate. Licensed contractors who are		M		\Box	
0.11	responsible for appropriate disposal and maintenance of these facilities provide				ш	
	appropriate and adequate portable toilets.					
	Sheet piling is provided at suitable location around the basement excavation to					
	reduce the effect of lowering the water table from any dewatering process. Any					ac and other
6.15	discharge of groundwater pumped out from any dewatering process of the	И	П		\neg	No grande of en
	construction works is treated to comply with the standards set in the relevant					was jonen 1
	discharge licence prior discharge. No discharge of the groundwater is allowed into					
	the two streams.					
7.00	Ecology (Construction Phase)	1				
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop	П	П		\neg	
	Shek Cemetery.					
7.02	Temporary accesses to the work sites are carefully planned and located to		П			
	minimise disturbance caused to the streams and nearby habitats.					
7.03	Less or smaller construction plants are used to reduce disturbance to the nearby			$ \Delta $		
	habitats.			/_		
7.04	Vehicles and other plants are carefully maintained and properly used to minimise					
	the chance for accidental spillage.			1		
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up	D				No spilkyes occurs.
	before they can contaminate streams or groundwater.					
7.06	Basement formation or any construction activities likely to pump out a large					N. Brochrock
7.06	quantity of groundwater are protected with sheet-piling at suitable locations	Ø		Ш	\sqcup	-vus general
	around the basement footneint, or his one like marked	-			- 1	I.S.
	around the basement footprint, or by any like method.		999			Me grant nota
7.07	around the basement footprint, or by any like method. No groundwater is pumped back to the two stream courses to protect the natural integrity of the stream habitat and the associated organism.	, \(\sigma \)				No ground note was generated



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy but not around the trunk.			d		
7.09	Works beneath the tree canopy are avoided: If encroachment under the canopy area is unavoidable, adequate protections are provided to ensure no damage of any part of the tree would occur due to the encroachment.			9		
7.10	Any tree transplanting and planting works are implemented by an approved Landscape Contractor. Quality control of the work is undertaken by a qualified Landscape Architect through site inspections and approval of works.					
7.11	Construction works are restricted within works area which are clearly defined.			D		
7.12	Woodland or other habitats that are affected by the construction works are well-defined and minimised.			d		
7.13	Human inference to habitats beyond the site boundary and habitats proposed to be retained are avoided by providing temporary barricades.			Ø		
7.14	Works area is reinstated immediately after completion of the construction.	Ø				the construction work Nes not lea compres
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control measures are provided in order to protect nearby habitats.			Ø		
7.16	Trees requiring transplantation or protection are identified based on the information illustrated in the Tree Survey Report.			Ø		
7.17	Is layout of the Project carefully designed to avoid or minimize the area of habitat loss and the numbers of trees to be felled?			Ø		
7.18	All trees are preserved as far as possible, especially species of conservation concern. Recommendations provided in the Tree Survey Report to mitigate impacts on trees shall be followed.			Ø		
7.19	Disturbance to the two plant species of conservation concern, namely Aquilaria sinensis and Cibotium barometz, is avoided. Where removal of these species is unavoidable, it is recommended to transplant them to habitats with similar conditions. Following transplantation, regular monitoring of these plants is conducted by a suitable qualified botanist / horticulturist over a 12-month period;			9		
7.20	Compensatory planting of the felled trees follows the Technical Circular No. 3/2006 issued by ETWB.	Ø				No planting mas
7.21	The Site inside or in the proximity of the streams and nearby habitats is temporarily isolated, by placing of sandbags or silt curtains with lead edge at the bottom and properly supported props, to prevent adverse impacts on these areas.			7		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			6		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			Ø		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			P		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			Ø		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			d		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			4		-
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			6		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			\not		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s) and Non-compliance(s) of Last Weekly Site Inspection:							
observation (s):							
N: 1							
Reminder (S)'.							
Ni)							
Note: Figure 4 at le entra	,5 regarding cle ce of the site	use 26 08 EP	has been displayed				
Signatures:	Contractor's	Architect's	IEC's				
Representative	Representative	Representative	Representative				
(Name: Tiphhy Kugas)	(Name: M. T. WONG)	(Name: L. Wants)	(Name: Hiton TAM)				



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST

Inspec	Inspection Date: May 2021 Inspected by:				John	my Ku	IDAY A	AR: L. Woy EC:
Inspec	etion Time: 10 am		Contra	ictor:	MY	Woo	<u>~</u> }⁰ п	EC:
Weath	ner						9	
Condi	tion Sunny	☐ Overcast	□ Drizzle		☐ Rair	ı	□ Sto	rm 🗆 Hazy
Temp	erature 33.1 °C		Humidity		☐ Higl	h	□/Mo	derate
Wind	☐ Calm ☐ Light	Breeze	☐ Strong					
	Environmental Mitigation Measures			N/A*	N/O*	Yes*	No*	Photo/Remarks
1.00	Air (Construction Phase)							
1.01	Vehicle washing facilities (including a high p		e provided at			7		
	every discernible or designated vehicle exit po							
1.02	Road between the washing facilities and the bituminous or hardcore material.	exit point is paved w	vith concrete,					
	Every main haul road is paved with concrete	, bituminous hardcore	materials or	7				
1.03	metal plates, and kept clear of dusty materials.	Or unpaved haul roads	and areas are					
	sprayed with water to keep the entire road surf	ace wet.						
	Stockpile of dusty material including demolish	ed items is either:						
	a) covered entirely by impervious sheeting, or	-						
1.04	b) placed in an area sheltered on the top and the	ne three sides, or						
	c) sprayed with water or a dust suppression c	hemical so as to maint	ain the entire			1		
	surface wet.							
	Exposed earth is properly treated by compaction	n, hydroseeding, vegeta	ation planting	,				The Construction work
1.05	or seating with latex, vinyl, bitumen within si	x months after the last	construction					completed
	activity on the site or part of the site where the	exposed earth lies.		*				completed
1.00		V]				
1.06	Water is sprayed to all dusty materials before l	oading or transfer opera	ation.			Ψ	Ш	
1.07	Any debris is covered entirely by impervious	ous sheeting or stored	in a debris	П	П			
	collection area sheltered on the top and the three	ee sides.						
1.08	Water is sprayed to debris before it is dumped	into a chute.				P		
1.09	Vehicles for transporting dusty materials/spo	oils are covered with	tarpaulin or					
1.09	similar material. The cover extends over the ed	ges of the sides and tai	ilboards.		Ш	لطر	ш	
	Water is sprayed immediately to the working a	rea for uprooting of tre	es, shrubs, or			/		
1.10	vegetation or the removal of boulders, pole,	pillars before, during	and after the					
	operation.							
1 11	Workers at all levels are co-operative to avoid of	lust generation and disp	persion to the					
1.11	surrounding environment.							
2.00	Noise (Construction Phase)							



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
	Only well-maintained plant is operated on site and the plant should be regularly					
2.01	serviced during the construction works	Ш	Ш	ļД	Ш	
2.02	Plant used intermittently is turned off or throttled down when not in active use.					
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.			ď		
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			ď		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			ď		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.	Ø				No excavated materials was stored on site
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).					
4.02	A billing account with EPD for disposal of construction waste is obtained.					
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Ø		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			Ø		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			P		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			Ø		
4.07	Training of site personnel in proper waste management and chemical waste handling procedures.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?					
4.09	Are sufficient waste disposal points and regular collection for disposal provided?					
4.10	Are appropriate measures to minimise windblown litter and dust during transportation of waste, such as covering trucks or transporting wastes in enclosed containers adopted?			Ø		
4.11	Is recording system for the amount of wastes generated, recycled and disposed of (including the disposal sites) implemented?					
4.12	Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal.			Ø		
4.13	Encourage collection of aluminium cans, plastic bottles and packaging material (e.g. carton boxes) and office paper by individual collectors. Separately labelled bins are provided to help segregate this waste from other general refuse generated by the work force.			ď		
4.14	Are C&D materials reused when possible to reduce the amount of C&D material/waste?			Ø		
4.15	Are wood, steel and other metals separated for reuse and / or recycling prior to disposal of C&D waste to minimise the quantity of waste to be disposed of to landfill?			\Box		
4.16	Minimise the potential for damage or contamination of construction material by having proper storage and site practices.			Þ		
4.17	Plan and stock construction materials carefully to minimise the amount of surplus materials.			₽′		
4.18	Rock and soil generated from excavation are reused for site formation and excavated material from foundation work reused for landscaping as far as practicable to avoid disposal off-site.	Ø				No excavated materials was stored on-site
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?			Ø		
4.20	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D material (public fill) is directed to an approved public filling area or reclamation site, where it has the benefit of offsetting the need for removal of materials from borrow areas for reclamation purposes and helps to reduce the pressure on landfill sites.			Ø		
4.21	Are individuals or companies who deliver public fill to public filling areas obtained dumping licences?			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			Ø		
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			Ø		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			Ø		
	Chemical Waste					•
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated					
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.					
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.					-
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Ø		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			Ø		
5.00	Landscape and Visual (Construction Phase)					
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?			Ø		
5.02	Are site offices and the construction yard decommissioned after construction?	Ø				Construction Work has not been completed
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?			Ø		
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?					
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?					The Construction work has not been completed
5.08	Are construction lights oriented away from the viewing location of VSRs?		Ø			
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?		Ø			
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			Ø		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Ø				The rooftop has not been constructed
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	ď				No planting Work
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Þ				1711 tree plant work was been completed
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			□⁄		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.					
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.					The Chirmey has not been constructed
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.	Ø				The chimney has not been constructed



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			Ø		
5.21	Are silting traps installed to minimize silting to streams?			Ø		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	ď				No planting Mork
5.23	Is amenity planting for open spaces included in the Project?	7		. 🗆		No planting work
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	P				No planting Worle
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Ø				No planting north
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			Þ		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.					
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.					
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			ď		
6.04	Works are carefully programmed to minimise soil excavation works during rainy seasons.	ď				No excavation Norte
6.05	Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion.					No excavation work
6.06	Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.			Q [′]		
6.07	Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections.	Ø				No examption work
6.08	Open stockpiles of construction materials on site are covered with tarpaulin or similar fabric during rainstorms.			þ		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility			ń		
	are settled out and removed before discharging into the storm drain.					
	Oil interceptor is provided in the drainage system and regularly emptied to					
6.10	prevent the release of oil and grease into the storm drainage system after					
	accidental spillage.					
6.11	Debris and rubbishes generated on site are collected, handled and disposed of					
6.11	properly to avoid them entering the two streams.				ш	
	All fuel tanks and storage areas are provided with locks and be sited on sealed					
6.12	areas, within bunds of a capacity equal to 110% of the storage capacity of the			\square		
	largest tank.					
	Open storm water drains and culverts near the works area are covered to block the			_/		
6.13	entrance of large debris and refuse.	ш			Ш	
	Portable chemical toilets handle the sewage from construction work force if the					
	existing toilets in the Site are not adequate. Licensed contractors who are				_	
6.14	responsible for appropriate disposal and maintenance of these facilities provide	Ш	14	Ш		
	appropriate and adequate portable toilets.					
	Sheet piling is provided at suitable location around the basement excavation to					
	ce the effect of lowering the water table from any dewatering process. Any			No around water was		
	discharge of groundwater pumped out from any dewatering process of the		_		_	(No grand water was
6.15	construction works is treated to comply with the standards set in the relevant					operated
	discharge licence prior discharge. No discharge of the groundwater is allowed into					V
	the two streams.					
7.00	Ecology (Construction Phase)					
7,000	Any affected trees are transplanted to grassland / scrubland within the Wo Hop					
7.01	Shek Cemetery.			Ø		
	Temporary accesses to the work sites are carefully planned and located to					
7.02	minimise disturbance caused to the streams and nearby habitats.			Ø		
	Less or smaller construction plants are used to reduce disturbance to the nearby					
7.03	habitats.			Ø		
	Vehicles and other plants are carefully maintained and properly used to minimise					
7.04				$ \angle $		
	the chance for accidental spillage.					
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up	Ø				No spillage occurred
	before they can contaminate streams or groundwater.					1 1
	Basement formation or any construction activities likely to pump out a large					No ground water
7.06	quantity of groundwater are protected with sheet-piling at suitable locations		Ш	П	Ш	was openerated
	around the basement footprint, or by any like method.					
7.07	No groundwater is pumped back to the two stream courses to protect the natural					No grandwater was generated
	integrity of the stream habitat and the associated organism.	/				0



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy			М		
7.08	but not around the trunk.		Ш	/	ш	
	Works beneath the tree canopy are avoided: If encroachment under the canopy					
7.09	area is unavoidable, adequate protections are provided to ensure no damage of any					
	part of the tree would occur due to the encroachment.					
	Any tree transplanting and planting works are implemented by an approved			/		
7.10	Landscape Contractor. Quality control of the work is undertaken by a qualified					
	Landscape Architect through site inspections and approval of works.					
7.11	Construction works are restricted within works area which are clearly defined.			Ø		
7.12	Woodland or other habitats that are affected by the construction works are well-					
7.12	defined and minimised.		Ш		П	
7.13	Human inference to habitats beyond the site boundary and habitats proposed to be			Á		
7.13	retained are avoided by providing temporary barricades.	Ш			Ш	
7.14	Works area is reinstated immediately after completion of the construction.	Þ				The Construction world has not been completed
7.15	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control			<u> </u>		
7.13	measures are provided in order to protect nearby habitats.	Ш	J LJ	4	ш	
7.16	Trees requiring transplantation or protection are identified based on the					
7.10	information illustrated in the Tree Survey Report.	Ш				
7.17	Is layout of the Project carefully designed to avoid or minimize the area of habitat					
	loss and the numbers of trees to be felled?					
	All trees are preserved as far as possible, especially species of conservation			/		
7.18	concern. Recommendations provided in the Tree Survey Report to mitigate					
	impacts on trees shall be followed.					
	Disturbance to the two plant species of conservation concern, namely Aquilaria					
	sinensis and Cibotium barometz, is avoided. Where removal of these species is		_		_	
7.19	unavoidable, it is recommended to transplant them to habitats with similar			И		
	conditions. Following transplantation, regular monitoring of these plants is					
	conducted by a suitable qualified botanist / horticulturist over a 12-month period;					
7.20	Compensatory planting of the felled trees follows the Technical	Ø				No planing work
	Circular No. 3/2006 issued by ETWB.	/-		_ _		7 0
	The Site inside or in the proximity of the streams and nearby habitats is				_	
7.21	temporarily isolated, by placing of sandbags or silt curtains with lead edge at the			\angle		
	bottom and properly supported props, to prevent adverse impacts on these areas.					



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			Ø		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			ď		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			Ø		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			Ø		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			Ø		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			Ø		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			Ø		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			ď		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s	s) and Non-compliance(s) of Last Week	dy Site Inspection:	
Remark/Follow up of Observation(s	s) and Non-compliance(s) of Last Week	dy Site Inspection:	
Reminder(s): Reminder(s): house Keeping Gonere 1000	chul be main	temed	
	ae 4,5 regardi	tine e of the 5H.	e.6 of EP has
Signatures:			TT-01
ET Paragentative	Contractor's	Architect's	IEC's
(Name: Juhnny Kucha)	(Name: M.Y. WONG)	(Name: L. Wokh)	Representative (Name:)



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

WEEKLY ENVIRONMENTAL INSPECTION CHECKLIST

Inspe	ection Date: 26 May	204	Inspected by	:	ET:	Johnny	Kunng		AR:	L. Wong	
Inspe	ection Time:			Contr	actor:	MY	Work) l	EC:		
Weat	ther)			
Cond	7	☐ Fine	□ Overcast	☐ Drizzle		□ Ra	in	□ Sto	orm	☐ Hazy	
Temp	perature 32.1°C	9		Humidity		☐ Hig	gh	□мо	oderate	□ Low	
Wind	□ Calm	☐ Light	□ Breeze	☐ Strong							
	Environmental Mitigation	Measures			N/A*	N/O*	Yes*	No*		Photo/Remark	is
1.00	Air (Construction Phase)										
1.01	Vehicle washing facilities (i	including a high p	ressure water jet) were	provided at							
1.01	every discernible or designat	ted vehicle exit poi	int.			Ц		Ш	-		_
1.02	Road between the washing	facilities and the	exit point is paved wi	th concrete,							
1.02	bituminous or hardcore mate	erial.				Ш	μ	Ш	-		
	Every main haul road is par	ved with concrete	, bituminous hardcore	materials or			7				S. 1995
1.03	metal plates, and kept clear or	f dusty materials. (Or unpaved haul roads a	nd areas are			Ø		_		
	sprayed with water to keep th	ne entire road surfa	ice wet.				/				
	Stockpile of dusty material in	ncluding demolishe	ed items is either:								
	a) covered entirely by imper	rvious sheeting, or									
1.04	b) placed in an area sheltered	d on the top and th	e three sides, or						_		
	c) sprayed with water or a d	lust suppression ch	nemical so as to maintai	in the entire							
	surface wet.										
	Exposed earth is properly trea	ited by compaction	, hydroseeding, vegetati	ion planting	/	6			Ti	e construction	nuls
1.05	or seating with latex, vinyl, b	oitumen within six	months after the last c	onstruction	Ø					nors not bear	h
	activity on the site or part of t	the site where the	exposed earth lies.		_					complete	7
1.06	Water is sprayed to all dusty r	matariala hafana la	- J:								
1.00	water is sprayed to an dusty i	materials before to	ading of transfer operati	ion.	Ш	Ц	4	ш	_		_
1.07	Any debris is covered entir	ely by imperviou	is sheeting or stored i	n a debris							
	collection area sheltered on th	ne top and the three	sides.		Ц	Ц		ш	_		_
1.08	Water is sprayed to debris before	fore it is dumned in	oto a chute								
	water is sprayed to debris ber	ore it is dumped in	ito a criute.		Ц	Ц	Į,	니	_		_
1.09	Vehicles for transporting du	sty materials/spoi	ls are covered with ta	arpaulin or	П		$\overline{\Box}$				155
	similar material. The cover ex	tends over the edg	es of the sides and tailb	oards.	Ц	ш			_		_
	Water is sprayed immediately	to the working are	a for uprooting of trees	, shrubs, or			,				
1.10	vegetation or the removal of	boulders, pole, p	illars before, during an	d after the			Ø		_		_
	operation.		_								
1.11	Workers at all levels are co-op-	erative to avoid du	st generation and disper	rsion to the							
	surrounding environment.				Ш	Ц		\Box	_		_
2.00	Noise (Construction Phase)										



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
2.01	Only well-maintained plant is operated on site and the plant should be regularly serviced during the construction works					
2.02	Plant used intermittently is turned off or throttled down when not in active use.			P		
2.03	Plant that emits noise strongly in one direction is oriented to face away from NSRs.					
2.04	Silencers, mufflers and enclosures for plant are applied where possible and maintained adequately throughout the works			Ø		
2.05	Where possible, mobile plant is sited away from NSRs			Ø		
2.06	PME is well maintained and used properly on site to minimise any excessive noise generated.			Þ		
2.07	Stockpiles of excavated materials and other structures such as site buildings should be used effectively to screen noise from the works.	Þ				Mo executed motortals 1-25 stored on site
3.00	Land Contamination (Construction Phase)					
	N/A to the Phase III development					
4.00	Waste Management (Construction Phase)					
4.01	The necessary waste disposal permits from the appropriate authorities are obtained, in accordance with the Waste Disposal Ordinance (Cap. 354), Waste Disposal (Chemical Waste) (General) Regulation and the Land (Miscellaneous Provision) Ordinance (Cap. 28).			Ø		
4.02	A billing account with EPD for disposal of construction waste is obtained.			Ø		
4.03	A Waste Management Plan (WMP), incorporated in an Environmental Management Plan (EMP) is prepared and submitted to the Engineer/Supervising Officer for approval. Reference is made to Environment, Transport and Works Bureau Technical Circular (Works) (ETWB TCW) 19/2005.			Þ		
4.04	An approved person to be responsible for good site practice is nominated, including arrangements for collection and effective disposal to an appropriate facility of all wastes generated at the site.			Ø		
4.05	Is authorised or licensed waste hauler used to collect specific category of waste?			Ø		
4.06	A trip-ticket system is included as one of the contractual requirements and implemented by the Environmental Team to monitor the disposal of C&D and solid wastes at public filling facilities and landfills, and to control fly tipping. Reference is made to ETWB TCW No. 31/2004.			9		
4.07	Training of site personnel in proper waste management and chemical waste			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks	
4.08	Is routine cleaning and maintenance programme for drainage systems, sumps and oil interceptors conducted?			1			
4.09	Are sufficient waste disposal points and regular collection for disposal provided?			Ø			
	Are appropriate measures to minimise windblown litter and dust during						
4.10	transportation of waste, such as covering trucks or transporting wastes in enclosed			Ø			
	containers adopted?						
4.11	Is recording system for the amount of wastes generated, recycled and disposed of						
4.11	(including the disposal sites) implemented?		Ш	Д	Ш		
4.12	Segregation and storage of different types of waste in different containers, skips						
4.12	or stockpiles to enhance reuse or recycling of materials and their proper disposal.	ш	П		Ш		
	Encourage collection of aluminium cans, plastic bottles and packaging material						
4.13	(e.g. carton boxes) and office paper by individual collectors. Separately labelled						
	bins are provided to help segregate this waste from other general refuse generated		Ш	ע ע	لكر		
	by the work force.						
4.14	Are C&D materials reused when possible to reduce the amount of C&D						
	material/waste?		Ц	Щ	ш		
	Are wood, steel and other metals separated for reuse and / or recycling prior to						
4.15	disposal of C&D waste to minimise the quantity of waste to be disposed of to						
	landfill?						
4.16	Minimise the potential for damage or contamination of construction material by					ПП	
	having proper storage and site practices.	ш					
4.17	Plan and stock construction materials carefully to minimise the amount of surplus						
	materials.			7) 	
	Rock and soil generated from excavation are reused for site formation and					No examited notion	
4.18	excavated material from foundation work reused for landscaping as far as	Ø				has stand theste	
	practicable to avoid disposal off-site.						
4.19	Is reuse of the public fill and C&D waste practiced on site as far as practicable?						
	The handling of C&D materials is governed by WBTC No. 2/93. Inert C&D						
	material (public fill) is directed to an approved public filling area or reclamation						
4.20	site, where it has the benefit of offsetting the need for removal of materials from				-		
1.20	borrow areas for reclamation purposes and helps to reduce the pressure on landfill			Д	_		
	sites.						
	Are individuals or companies who deliver public fill to public filling areas						
4.21	obtained dumping licences?			Ø			
	70		700				



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
4.22	Are careful design, planning and good site management adopted to minimise overordering and generation of waste materials such as concrete, mortar and cement grouts? The design of formwork maximise the use of standard wooden or metal panels so that high reuse levels can be achieved. Alternatives such as steel formwork, plastic fencing and reusable site office structures are considered to increase the potential for reuse and minimize C&D waste generation.			Ø		
4.23	The contractor uses as much as possible of the C&D material on-site. Proper segregation of waste types on site will increase the feasibility of certain components of the waste stream by recycling contractors.			d		
4.24	General refuse is stored in enclosed bins or compaction units separate from C&D and chemical wastes. A reputable waste collector is employed by the Contractor to remove general refuse from the site, separately from C&D and chemical wastes, on a daily or every second day basis to minimise odour, pest and litter impacts.			P		
	Chemical Waste					
4.25	Contractor registers with the EPD as chemical waste producer if any chemical waste is generated			Ø		
4.26	All the chemical waste is handled according to the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. The chemical waste is stored and collected by an approved contractor for disposal at a licensed facility in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.			Ø		
4.27	Principles of reuse and recycle chemical waste on site as far as practicable is adopted by the contractor.			P		
4.28	Are unused chemicals or those with remaining functional capacity reused as far as practicable?			Þ		
4.29	Disposal of chemical waste via a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Facility at Tsing Yi, which offers a chemical waste collection service and can supply the necessary storage containers or a waste recycling plant approved by EPD.			7		
5.00	Landscape and Visual (Construction Phase)					
5.01	Do site offices have olive green roof and façade coating or colour that matche with existing environment?	, A		70		and the transfer
5.02	Are site offices and the construction yard decommissioned after construction?	Ø		M		nos wither conflict
5.03	The height of site offices, including the rooftop does not exceed 10m, except building services equipment such as antennas, which exceeds 10 m but is coated in black.			⊿		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.04	Is site hoarding with 2.4m height and colour in harmony with the surrounding environment erected along the site boundary until the completion of relevant construction phases?			口		
5.05	Are construction plants and building materials orderly and carefully stored to appear neat and avoid visibility from outside where practical?			Ø		
5.06	Are excess materials removed from site as soon as practical?			Ø		
5.07	Are all construction plants removed from site upon completion of construction works?					hasnet hoes completely
5.08	Are construction lights oriented away from the viewing location of VSRs?		Ø			
5.09	Are all lightings facing sensitive receiver installed with frosted diffusers and reflective covers?		Ø			
5.10	Trees that require removal are transplanted on site if practical. If not practical, these trees will be transplanted in locations within the vicinity as approved by the Architect.			p		
5.11	Planting works are carried out under the supervision of a specialist landscape specialist.			Ø		
5.12	The rooftop of the cremation plant room is planted with lawn.	Z				the roottop has not heen contructed
5.13	New trees, shrubs and groundcover are carefully selected and designed to homogenize with the environment.	Ø				No planting mil
5.14	No tree is transplanted or felled without prior approval by relevant Government departments.			Ø		
5.15	All trees that are marked for retention are fenced off with a 1.2m high fence around the dripline of trees or larger area as far as feasible.	Ø				has been completel
5.16	Transplant preparation works are carried out as soon as possible after the commencement of construction. Over-pruning such as hard pruning of tree crown, pollarding or topping are avoided. Rootball and crown pruning are carried out over at least 3 months.			P		
5.17	Existing shrub and ground cover planting areas that will not be removed are maintained in good condition and enhanced if practical.			Ø		
5.18	The chimney has been designed to have sculptural outlook and articulated. It is kept in proportion with the rest of the building.	Ø				The chings has not been constructed
5.19	The chimney stack is designed to locate at the least conspicuous location of the site to VSRs.	6				Jeen Gnothery



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
5.20	Bi-weekly checking would be performed on the nine Terminalia mantaly trees within and outside the works area of the Project, or otherwise if the transplantations are not carried out according to the plan.			Ø		
5.21	Are silting traps installed to minimize silting to streams?			d		
5.22	Is the tree compensation to tree loss ratio at least 1:1 in term of quantity? About 100 trees will be planted to compensate for the loss of 54 trees. 100 trees will be planted on site and others, in locations within the vicinity approved by the Architect	Ø				No plantity Lork
5.23	Is amenity planting for open spaces included in the Project?	Ø				No plantie north
5.24	Is screen planting such as planting a roll of trees along the site boundary butting Kiu Tau Road carried out?	Þ				No glentig nork
5.25	Woodland mix, comprising of tree seedlings and shrubs, are planted within the Wo Hop Shek Cemetery to enhance the ecological value and compensatory of tree loss.	Ø				No plenting nork.
5.26	Is the 10m height headroom cremation plant room half-sunken to reduce the visual impact to pedestrians?			Д		
6.00	Water Quality (Construction Phase)					
6.01	Wastewater is properly treated to meet the discharge standards set out in the relevant Water Pollution Control Ordinance (WPCO) discharge licence. No direct discharge of site runoff into the two streams is allowed.			Ø		
6.02	Perimeter channels are provided to intercept storm runoff from outside the site. The channels are constructed in advance of site formation works and earthworks.			Ø		
6.03	Sand/silt removal facilities such as sand traps, silt traps and sediment basins are provided to remove sand/silt particles from runoff to meet the requirements of the Technical Memorandum standard under the WPCO.			Ø		
6.04	Works are carefully programmed to minimise soil excavation works during rainy seasons.	Ø				No exercita nonle
6.05	Exposed soil surfaces are protected by paving as soon as possible to reduce the potential of soil erosion.	Ø				No exerction work
6.06	Temporary access roads are protected by crushed gravel and exposed slope surfaces are protected when rainstorms are likely to occur.	Ø		Ø		
6.07	Trench excavation is avoided in the wet season as far as practicable, and if necessary, these trenches are excavated and backfilled in short sections.	Ø				No excavatha nork.
6.08	Open stockpiles of construction materials on site are covered with tarpaulin or similar fabric during rainstorms.			Ø		



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
6.09	Sand and silt in the wash water from the wheel from the wheel washing facility are settled out and removed before discharging into the storm drain.			d		
6.10	Oil interceptor is provided in the drainage system and regularly emptied to			<u> </u>		
0.10	prevent the release of oil and grease into the storm drainage system after accidental spillage.		Ц		Ш	-
6.11	Debris and rubbishes generated on site are collected, handled and disposed of					
	properly to avoid them entering the two streams.					
6.12	All fuel tanks and storage areas are provided with locks and be sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the			ď		
	largest tank.					
6.13	Open storm water drains and culverts near the works area are covered to block the entrance of large debris and refuse.			otin		
	Portable chemical toilets handle the sewage from construction work force if the					
6.14	existing toilets in the Site are not adequate. Licensed contractors who are		Ø			
	responsible for appropriate disposal and maintenance of these facilities provide appropriate and adequate portable toilets.					
	Sheet piling is provided at suitable location around the basement excavation to					
6.15	reduce the effect of lowering the water table from any dewatering process. Any					
	discharge of groundwater pumped out from any dewatering process of the					1/ oran to the way
0.13	construction works is treated to comply with the standards set in the relevant		П	Ш	ш	No grandnate nas
	discharge licence prior discharge. No discharge of the groundwater is allowed into					Senon a:
	the two streams.					
7.00	Ecology (Construction Phase)					
7.01	Any affected trees are transplanted to grassland / scrubland within the Wo Hop					
	Shek Cemetery.			-		
7.02	Temporary accesses to the work sites are carefully planned and located to minimise disturbance caused to the streams and nearby habitats.			P		
	Less or smaller construction plants are used to reduce disturbance to the nearby					
7.03	habitats.					
7.04	Vehicles and other plants are carefully maintained and properly used to minimise	П	П	П	П	
	the chance for accidental spillage.			<u></u>		
7.05	Any spillages that do occur are quickly identified and appropriately cleaned up					No spillages occured
	before they can contaminate streams or groundwater.		***			1 45
7.06	Basement formation or any construction activities likely to pump out a large		_		_	No graduate
7.00	quantity of groundwater are protected with sheet-piling at suitable locations around the basement footprint, or by any like method.	7	Ш	П	□	was generated
	No groundwater is pumped back to the two stream courses to protect the natural	_			_	No craduata
7.07	integrity of the stream habitat and the associated organism.					Kne penaeth



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.08	Sturdy 1.8 metres protective fencings are located at the edge of the tree canopy			Ø		
	but not around the trunk. Works beneath the tree canopy are avoided: If encroachment under the canopy				_	
7.00	area is unavoidable, adequate protections are provided to ensure no damage of any	П	П	$ \overline{n} $	П	
7.09	part of the tree would occur due to the encroachment.			7		
	Any tree transplanting and planting works are implemented by an approved					
7.10	Landscape Contractor. Quality control of the work is undertaken by a qualified	П	П			
7.10	Landscape Architect through site inspections and approval of works.	_		7	_	
	Editabeth / Herinet meg.					
7.11	Construction works are restricted within works area which are clearly defined.			Ø		
7.10	Woodland or other habitats that are affected by the construction works are well-		П	\square		
7.12	defined and minimised.			<u> </u>		
7.13	Human inference to habitats beyond the site boundary and habitats proposed to be	П	П	\square	П	
7.13	retained are avoided by providing temporary barricades.					The amothetic home
7.14	Works area is reinstated immediately after completion of the construction.	Ø				has not been appleted
	Uncontrolled burning of refuse is strictly prohibited. Appropriate fire control					
7.15	measures are provided in order to protect nearby habitats.			7		
7.16	Trees requiring transplantation or protection are identified based on the		П	M		
7.10	information illustrated in the Tree Survey Report.					
7.17	Is layout of the Project carefully designed to avoid or minimize the area of habitat		П	ń		
7.17	loss and the numbers of trees to be felled?					
	All trees are preserved as far as possible, especially species of conservation					
7.18	concern. Recommendations provided in the Tree Survey Report to mitigate			otag		
	impacts on trees shall be followed.					
	Disturbance to the two plant species of conservation concern, namely Aquilaria					
	sinensis and Cibotium barometz, is avoided. Where removal of these species is	_	_		_	
7.19	unavoidable, it is recommended to transplant them to habitats with similar				Ш	
	conditions. Following transplantation, regular monitoring of these plants is					
	conducted by a suitable qualified botanist / horticulturist over a 12-month period;	-				
7.20	Compensatory planting of the felled trees follows the Technical					No plantle more
	Circular No. 3/2006 issued by ETWB.	_				1 3
	The Site inside or in the proximity of the streams and nearby habitats is	_	_			
7.21	temporarily isolated, by placing of sandbags or silt curtains with lead edge at the		Ц			
	bottom and properly supported props, to prevent adverse impacts on these areas.					



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Contract no. AL G513 Expansion of Wo Hop Shek Crematorium

	Environmental Mitigation Measures	N/A*	N/O*	Yes*	No*	Photo/Remarks
7.22	Appropriate storage locations are situated well away from the streams and nearby habitats for the temporary storage of materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction debris and spoil are identified before commencement of the works.			Ó		
7.23	Stockpiling of construction materials, are covered and located away from the streams and nearby habitats.			d		
7.24	Construction debris and spoil are covered up and/or properly disposed of as soon as possible to avoid being washed into the streams and nearby habitats by rain.			7		
7.25	Construction effluent, site runoff and sewage is properly collected and/or treated.			P		
7.26	Proper locations for discharge outlets of any wastewater treatment facilities well away from the streams and nearby habitats are identified.			Á		
7.27	Vehicles and other plant are carefully maintained and properly used to minimise the chance for accidental spillage.			Þ		
7.28	Temporary geo-textile silt fences around earth moving works are erected to trap any sediments being washed away and prevent them from entering surrounding areas.			Ø		
7.29	Exposed soil or other loose materials are covered with tarpaulins to prevent erosion, and then seeded and covered with a biodegradable geotextile blanket for erosion control purposes.			7		

*Remarks:

N/A = Not applicable at current stage

N/O = Not observed in the site walk

Yes = Compliance

No = Non-compliance



Unit 1908, Nos. 301-305 Castle Peak Road, Kwai Chung, N.T. O: 2333-6823 | F: 2333-1316 | E: general@acuityhk.com | www.acuityhk.com

Remark / Follow up of Observation(s)	and Non-compliance(s) of Last Weekly	Site Inspection:	
Observation (5)			
Reminden (5): -) chemical maste	should be di	sposed in chemical	raste storge ana
Note: Figure at the Entrane	t, 5 regarding to	alause 3.6 of Ef	has been displayed
Signatures:			
ET	Contractor's	Architect's	IEC's
Representative	Representative	Representative	Representative
	115	Wylk	
(Name: Johny Karaha	(Name: M.Y. WODG)	(Name: L. WOWN)	(Name:)

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX L: STATISTICS ON COMPLAINT, NOTIFICATIONS OF SUMMONS AND SUCCESSFUL PROSECUTIONS



Statistical Summary of Exceedances

	Air Quality									
Location Action Level Limit Level Total										
A10	0	0	0							
A20	0	0	0							

Statistical Summary of Environmental Complaints

Reporting Period	Envir	onmental Complaint Stat	cistics		
Period	Frequency	Cumulative	Complaint Nature		
01 May 2021 - 31 May 2021	0	0	N/A		

Statistical Summary of Environmental Non-compliance

Reporting Period	Environmental Non-compliance Statistics			
	Frequency	Cumulative	Details	
01 May 2021 - 31 May 2021	0	0	N/A	

Statistical Summary of Environmental Summons

Reporting	Environmental Summons Statistics			
Period	Frequency	Cumulative	Details	
01 May 2021 - 31 May 2021	0	0	N/A	

Statistical Summary of Environmental Prosecution

Reporting Period	Environmental Prosecution Statistics			
	Frequency	Cumulative	Details	
01 May 2021 - 31 May 2021	0	0	N/A	

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX M: IMPACT MONITORING SCHEDULE OF NEXT REPORTING MONTH



Impact Monitoring Schedule for Expansion of Wo Hop Shek Crematorium							
Jun-21							
Sun	Mon					Sat	
		1	2	3	4	5	
			Air monitoring for A10, A20 for 1- hr TSP and 24-hr TSP Monitoring Time: 0900-1630	Weekly ET site inspection and audit			
6	7	8	9	10	11	12	
		Air monitoring for A10, A20 for 1- hr TSP and 24-hr TSP Monitoring Time: 0900-1630	Weekly ET site inspection and audit			Air monitoring for A10, A20 for 1- hr TSP and 24-hr TSP Monitoring Time: 0900-1630	
13	14	15	16	17	18	19	
			Weekly ET site inspection and audit		Air monitoring for A10, A20 for 1- hr TSP and 24-hr TSP Monitoring Time: 0900-1630		
20	21	22	23	24	25	26	
			Weekly ET site inspection and audit	Air monitoring for A10, A20 for 1- hr TSP and 24-hr TSP Monitoring Time: 0900-1630			
27	28	29	30				
		Air monitoring for A10, A20 for 1- hr TSP and 24-hr TSP Monitoring Time: 0900-1630	Weekly ET site inspection and audit				

^{*}Remarks: 1. This impact monitoring schedule is subject to change due to adverse weather conditions or other rationales.


^{2.} Advance notification of the changes will be given to all relevant parties at lease 48 hours prior to implementation.

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15




APPENDIX N: TRANSPORTATION ROUTES TO/FROM THE SITE



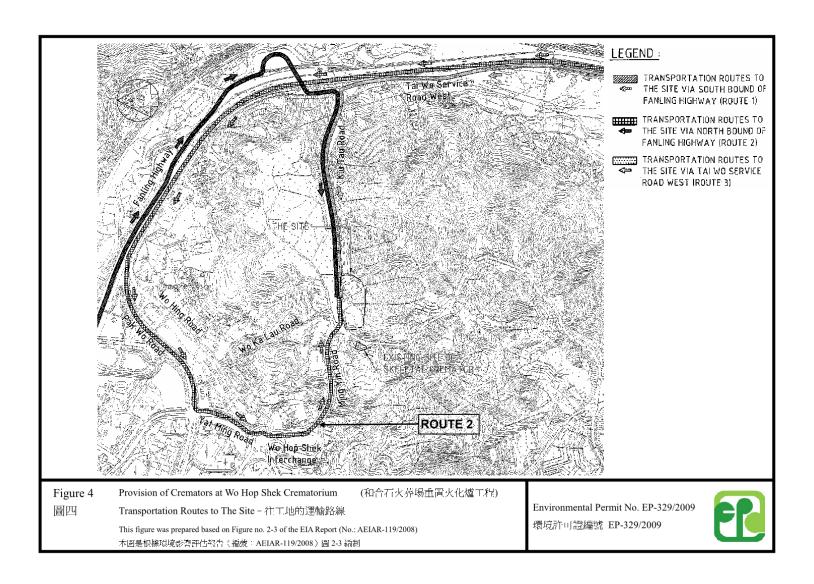



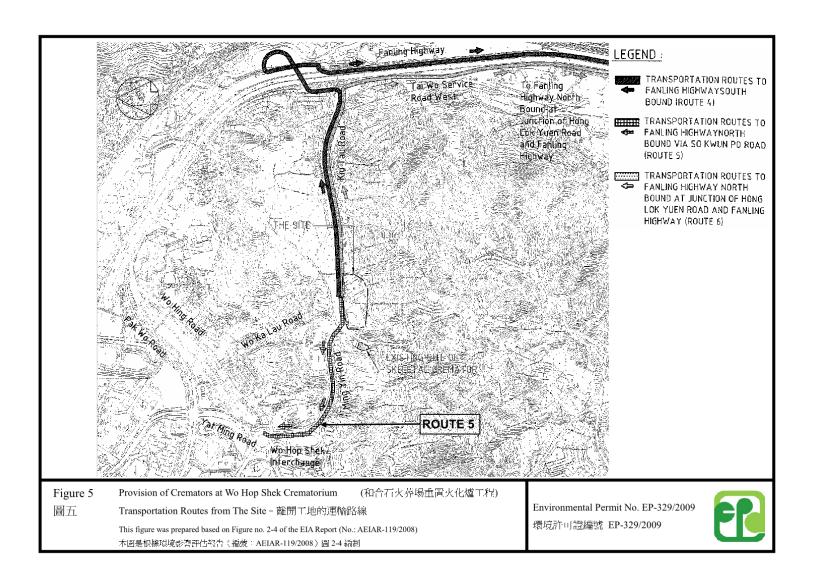

Contract No. AL G513 Expansion of Wo Hop Shek Crematorium Monthly EM&A Report No.15



APPENDIX O: LAB REPORT

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q210003aR210603

Job Number

: R210603

Issue Date

: 13/05/2021

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R210603/1-2

Date of Sampling

: 05/05/2021

Date Received

: 05/05/2021

Test Period

: 05/05/2021 - 06/05/2021

Test Required

: 1. Total Suspended Particulates (TSP)

Method Used

: 1. Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.

E-mail: htthui@acumenhk.com

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q210003aR210603

Job Number

: R210603

Issue Date

: 13/05/2021

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R210603/1	05/05/2021	Fung Kai Liu Yun Sum Memorial School	2.7639	2.8812	0.1173
R210603/2	05/05/2021	Fanling Government Secondary School	2.7368	2.8365	0.0997

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q210003aR210620

Job Number

: R210620

Issue Date

: 18/05/2021

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R210620/1-2

Date of Sampling

: 11/05/2021

Date Received

: 11/05/2021

Test Period

: 11/05/2021 - 12/05/2021

Test Required

: 1. Total Suspended Particulates (TSP)

Method Used

: 1. Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q210003aR210620

Job Number

: R210620

Issue Date

: 18/05/2021

Test Result:

1001110					
Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R210620/1	11/05/2021	Fung Kai Liu Yun Sum Memorial School	2.7628	2.8076	0.0448
R210620/2	11/05/2021	Fanling Government Secondary School	2.7599	2.7954	0.0355

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Hong Kong Accreditation Service (HKAS) has accredited Acumen Laboratory and Testing Limited (Reg. No. HOKLAS 241 - TEST) under the Hong Kong Laboratory Accreditation Scheme (HOKLAS) for specific laboratory activities as listed in the HOKLAS directory of accredited laboratories. This report is issued subject to Acumen Laboratory and Testing Limited standard TERMS AND CONDITIONS, and shall not be reproduced except in full or with written approval by Acumen Laboratory and Testing Limited. The result(s) of this report are applied to the sample(s) submitted only.

E-mail: htthui@acumenhk.com

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q210003aR210657

Job Number

: R210657

Issue Date

: 26/05/2021

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R210657/1-2

Date of Sampling

: 17/05/2021

Date Received

: 17/05/2021

Test Period

: 17/05/2021 - 18/05/2021

Test Required

: 1. Total Suspended Particulates (TSP)

Method Used

: 1. Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Acumen Laboratory and Testing Limited Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong

Fax: (852) 2333 1316 Tel: (852) 2333 6823

Test Report

Page 2 of 2

Report Number

: Q210003aR210657

Job Number

: R210657

Issue Date

: 26/05/2021

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R210657/1	17/05/2021	Fung Kai Liu Yun Sum Memorial School	2.7516	2.7801	0.0285
R210657/2	17/05/2021	Fanling Government Secondary School	2.7465	2.7716	0.0251

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q210003aR210679

Job Number

: R210679

Issue Date

: 02/06/2021

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R210679/1-2

Date of Sampling

: 22/05/2021

Date Received

: 22/05/2021

Test Period

: 22/05/2021 - 23/05/2021

Test Required

: 1. Total Suspended Particulates (TSP)

Method Used

: 1. Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q210003aR210679

Job Number

: R210679

Issue Date

: 02/06/2021

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R210679/1	22/05/2021	Fung Kai Liu Yun Sum Memorial School	2.7570	2.8025	0.0455
R210679/2	22/05/2021	Fanling Government Secondary School	2.7655	2.7999	0.0344

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 1 of 2

Report Number

: Q210003aR210681

Job Number

: R210681

Issue Date

: 02/06/2021

Name of Applicant

: Acuity Sustainability Consulting Limited

Address of Applicant

: Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung

Sha Wan, Kowloon, Hong Kong

Project Name

: ASCL-2018028 Expansion of Wo Hop Shek Crematorium

Sample Description

: Total Suspended Particulates

Laboratory ID

: R210681/1-2

Date of Sampling

: 27/05/2021

Date Received

: 27/05/2021

Test Period

: 27/05/2021 - 28/05/2021

Test Required

: 1. Total Suspended Particulates (TSP)

Method Used

: 1. Gravimetric method

Test Result

: Refer to the results on page 2.

For and on behalf of

Acumen Laboratory and Testing Limited

Authorized Signature:

Hui Wai Fung, Huntington

Laboratory Manager

Chemical Division

Lot 12, Tam Kon Shan Road, Tsing Yi (N), Hong Kong Tel: (852) 2333 6823 Fax: (852) 2333 1316

Test Report

Page 2 of 2

Report Number

: Q210003aR210681

Job Number

: R210681

Issue Date

: 02/06/2021

Test Result:

Lab ID	Date of Sampling	Client Sample ID	Initial Weight (g)	Final Weight (g)	Total Suspended Particulates (g)
R210681/1	27/05/2021	Fung Kai Liu Yun Sum Memorial School	2.7508	2.7823	0.0315
R210681/2	27/05/2021	Fanling Government Secondary School	2.7464	2.7625	0.0161

Note:

- 1. < indicates less than.
- 2. > indicates more than.
- 3. NA indicates Not Applicable.

End of Report