CONTRACT NO: HK/2011/07

WANCHAI DEVELOPMENT PHASE II AND CENTRAL WANCHAI BYPASS
SAMPLING, FIELD MEASUREMENT AND TESTING WORK (STAGE 2)

ENVIRONMENTAL PERMIT NO. EP- 416/2011 AND FEP- 01/416/2011

SHATIN TO CENTRAL LINK (SCL) PROTECTION WORKS AT CAUSEWAY BAY TYPHOON SHELTER (CBTS)

MONTHLY ENVIRONMENTAL MONITORING & AUDIT REPORT
- NOVEMBER 2013 -

CLIENTS:

Civil Engineering and Development Department

and

Highways Department

PREPARED BY:

Lam Geotechnics Limited

11/F Centre Point 181-185 Gloucester Road, Wanchai, H.K.

Telephone: (852) 2882-3939
Facsimile: (852) 2882-3331
E-mail: info@lamenviro.com
Website: http://www.lamenviro.com

CERTIFIED BY:

Raymond Dai

Environmental Team Leader

DATE:

09 December 2013



Ref.: AACWBIECEM00_0_4681L.13

11 December 2013

By Post and Fax (2691 2649)

AECOM Asia Company Limited 11/F, Tower 2 Grand Central Plaza 138 Shatin Rural Committee Road Shatin, New Territories Hong Kong

Attention: Mr. Conrad Ng

Dear Sir,

Re: Shatin to Central Link – Protection Works at Causeway Bay Typhoon Shelter Monthly Environmental Monitoring and Audit Report (November 2013) for EP-416/2011 & FEP-01/416/2011

Reference is made to the Environmental Team's submission of the captioned Monthly Environmental Monitoring and Audit (EM&A) Report for November 2013 received by email on 9 December 2013.

Please be informed that we have no adverse comment on the captioned submission. We write to verify the captioned submission in accordance with Condition 3.4 in the captioned Environmental Permit.

Thank you very much for your kind attention and please do not hesitate to contact the undersigned should you have any queries.

Yours sincerely,

David Yeung

Independent Environmental Checker

c.c.	HyD	Mr. Cyrus Wong	by fax: 2761 1508
	HyD	Mr. Jones Lai	by fax: 2714 5289
	CEDD	Mr. Robert Tsoi	by fax: 2577 5040
	AECOM	Mr. Peter Poon	by fax: 3912 3010
	AECOM	Mr. Frankie Fan	by fax: 2587 1877
	MTRCL	Mr. Richard Kwan	by fax: 2993 7577
	Lam	Mr. Raymond Dai	by fax: 2882 3331

Q:\Projects\AACWBIECEM00\Corr\AACWBIECEM00_0_4681L:13.doc



TABLE OF CONTENTS

EXI	KECUTIVE SUMMARY	3
1	INTRODUCTION	5
	1.1 Scope of the Report	
2	PROJECT BACKGROUND	7
	Background Scope of the Project and Site Description Project Organization and Contact Personnel	7
3	STATUS OF REGULATORY COMPLIANCE	9
	3.1 Status of Environmental Licensing and Permitting under the Pr	oject10
4	MONITORING REQUIREMENTS	12
	4.1 Noise Monitoring	13
5	MONITORING RESULTS	18
	 5.1 Noise Monitoring Results 5.2 Air quality monitoring Results 5.3 Water quality monitoring Results 5.4 Waste Monitoring Results 	18 18
6	COMPLIANCE AUDIT	21
	 6.1 Noise Monitoring 6.2 Air quality monitoring 6.3 Water quality monitoring 6.4 Review of the Reasons for and the Implications of Non-complia 6.5 Summary of action taken in the event of and follow-up on non-compliance 	21 21 ance21
7	CUMULATIVE CONSTRUCTION IMPACT DUE TO THE CONCURRE	NT PROJECTS 22
8	ENVIRONMENTAL SITE AUDIT	27
9	COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION	l28
10	CONCLUSION	20

LIST OF TABLES

Table I	Summary of Water Quality Monitoring Exceedances in Reporting Month
Table 2.1	Schedule 2 Designated Projects under this Project
Table 2.2	Contact Details of Key Personnel
Table 3.1	Summary of the current status on licences and/or permits on environmental protection pertinent to the Project
Table 3.2	Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/15
Table 3.3	Summary of submission status under EP/416/2011 and FEP-01/416/2011
Table 4.1	Noise Monitoring Stations
Table 4.2	Air quality monitoring Stations
Table 4.3	Marine Water Quality Stations for Water Quality Monitoring
	Marine Water Quality Monitoring Frequency and Parameters
Table 5.1	Noise Monitoring Station
	Air quality monitoring Station
Table 5.3	Water quality monitoring Station
Table 5.4	Summary of Water Quality Monitoring Exceedance in Reporting Month
	Details of Waste Disposal
Table 9.1	Cumulative Statistics on Complaints
	Cumulative Statistics on Successful Prosecutions
Table 10 1	Summary of Key Construction Activities of Individual Contract(s) to be

LIST OF FIGURES

LIST OF APPENDICES

Figure 2.1

Figure 2.2

Figure 2.3

Appendix 3.1	Environmental Mitigation Implementation Schedule
Appendix 4.1	Action and Limit Level
Appendix 4.2	Copies of Calibration Certificates
Appendix 5.1	Monitoring Schedule for Reporting Month and Coming month
Appendix 5.2	Noise Monitoring Results and Graphical Presentations
Appendix 5.3	Air Quality Monitoring Results and Graphical Presentations
Appendix 5.4	Water Quality Monitoring Results and Graphical Presentations
Appendix 6.1	Event Action Plans
Appendix 6.2	Summary of Notification of Exceedances
Appendix 7.1	Complaint Log
Appendix 8.1	Construction Programme of Individual Contracts

Locations of Environmental Monitoring Stations

commenced in Coming Reporting Month

Project Layout

Project Organization Chart

2

EXECUTIVE SUMMARY

- i. This is the Environmental Monitoring and Audit (EM&A) Monthly Report November 2013 specific for Environmental Permit no. EP-416/2011 and Further Environmental Permit no. FEP-01/416/2011 on Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter (CBTS). The Shatin to Central Link (SCL) protection works inside the Causeway Bay Typhoon Shelter (CBTS) is entrusted to the Central-Wanchai Bypass (CWB) project and will be carried out concurrently with the construction of the CWB under contract no. HY/2009/15. The construction impact of the SCL protection works on the environment is monitored together with that of the CWB by the Environmental Team (ET) employed under Contractor No. HK/2011/07. This EM&A report captures the environmental monitoring findings and information recorded during the period October 2013 to November 2013. The cut-off date of reporting is on the 27th of each reporting month.
- ii. In the reporting period, the principal work activity is included as follows:
 - Trimmings works and tunnel structure works at ME4

Noise Monitoring

iii. Noise monitoring during daytime was conducted at M2b - Noon-day gun area on a weekly basis. No exceedance was recorded in the reporting period.

Air quality monitoring

iv. 1-hour and 24-hour Total Suspended Particulates (TSP) monitoring were conducted at CMA3a - CWB PRE Site Office Area. No exceedance was recorded in the reporting period.

Water Quality monitoring

- v. Water quality monitoring at C7 was conducted three days per week during the reporting period. The action and limit level exceedance of water quality monitoring are summarized in **Table I**.
- vi. One action level DO exceedance was recorded at C7 in this reporting month. The exceedance was considered not related to Project works.

Table I Summary of Water Quality Monitoring Exceedances in Reporting Month

	Water	Mid-flood				Mid-ebb							
Contract no.	quality monitoring Station	D	0	Turb	idity	S	S	D	0	Turb	idity	S	S
		AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL
HY/2009/15	C7	1	0	0	0	0	0	0	0	0	0	0	0
Total		1	0	0	0	0	0	0	0	0	0	0	0

Complaints, Notifications of Summons and Successful Prosecutions

vii. There was no complaint received in this reporting period.

Site Inspections and Audit

viii. The Environmental Team (ET) conducted weekly site inspections for Contract no. HY/2009/15 - Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter (CBTS), in this reporting period. No non-conformance was identified during the site inspections.

Future Key Issues

- ix. In coming reporting month, the principal work activity is anticipated as follows:
 - Tunnel construction works at ME4



1 INTRODUCTION

1.1 Scope of the Report

- 1.1.1. Lam Geotechnics Limited (LGL) has been appointed to work as the Environmental Team (ET) under Environmental Permit no. EP-416/2011 and Further Environmental permit nos. FEP-01/416/2011 to implement the Environmental Monitoring and Audit (EM&A) programme as stipulated in the EM&A Manual of the approved Environmental Impact Assessment (EIA) Report for Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter (CBTS) (Register No.: AEIAR-159/2011) and in the EM&A Manual of the approved EIA Report for Shatin to Central Link Protection Works at Causeway Bay Typhoon Shelter (Register No. AEIAR-159/2011).
- 1.1.2. This report presents the environmental monitoring and auditing work carried out in accordance to the Section 7.5 of EM&A Manual and Environmental Monitoring and Audit Requirements of Environmental permit nos. EP-416/2011 and Further Environmental permit nos. FEP-01/416/2011.
- 1.1.3. This report documents the finding of EM&A works for Environmental Permit (EP) no. EP-416/2011, Further Environmental Permit (FEP) nos. FEP-01-416/2011 during the period October 2013 to November 2013. The cut-off date of reporting is at 27th of each reporting month.

1.2 Structure of the Report

- **Section 1** *Introduction* details the scope and structure of the report.
- **Section 2 Project Background** summarizes background and scope of the project, site description, project organization and contact details of key personnel during the reporting period.
- **Section 3 Status of Regulatory Compliance** summarizes the status of valid Environmental Permits / Licenses during the reporting period.
- **Section 4** *Monitoring Requirements* summarizes all monitoring parameters, monitoring methodology and equipment, monitoring locations, monitoring frequency, criteria and respective event and action plan and monitoring programmes.
- **Section 5** *Monitoring Results* summarizes the monitoring results obtained in the reporting period.
- **Section 6 Compliance Audit** summarizes the auditing of monitoring results, all exceedances environmental parameters.

Section 7	Cumulative	Cor	nstruction	Impact de	ue to t	he Co	ncurren	t Pro	ject	ts –
	summarizes	the	relevant	cumulative	constru	uction	impact	due	to	the
	concurrent ac	tivitie	es of the co	oncurrent Pr	ojects.					

Section 8Site Inspection – summarizes the findings of weekly site inspections undertaken within the reporting period, with a review of any relevant follow-up actions within the reporting period.

Section 9 *Complaints, Notification of summons and Prosecution* – summarizes the cumulative statistics on complaints, notification of summons and prosecution

Section 10 Conclusion




2 PROJECT BACKGROUND

2.1 Background

- 2.1.1. The "Shatin to Central Link Protection Works at Causeway Bay Typhoon Shelter" (hereafter called "the Project") is a Designed Project (DP) under the Environmental Impact Assessment Ordinance (Cap. 499) (EIAO). The Environmental Impact Assessment (EIA) Reports for Shatin to Central Link Protection Works at CBTS (Register No. AEIAR-159/2011) has been approved on 25 Feb 2011.
- 2.1.2. The key purpose of the SCL Protection Works and associated works at CBTS involves the construction of a 160m tunnel box by cut-and-cover method at the crossing above the Central Wan Chai Bypass (CWB) tunnels. Temporary reclamation is required and has been authorized under the Foreshore and Sea-bed (reclamations) Ordinance. With the presence of the Protection Works, future construction of the SCL on both sides of the CWB tunnels is protected and ensured feasible without damaging or unduly affecting the CWB tunnels which could be operational by then. This arrangement will also minimize public nuisance and impact to the surrounding environment as it can reduce the reclamation area for subsequent construction of the SCL after CWB is completed. Nevertheless, the Protection Works cannot serve to function for any railway service or operation before the completion of SCL.
- 2.1.3. The SCL is strategically important for connecting the existing railway lines into an integrated rail network. The east-west connection will allow the setup of a 57km East-West Corridor across the city connecting Wu Kai Sha with Tuen Mun via Kowloon; whilst the north-south connection will operate over a 41km North-South Corridor with services originating in Lok Ma Chau or Lo Wu travelling via the existing East Rail Line (EAL) to Admiralty. This will enable a direct transportation linkage between Mainland China and Hong Kong Island.

2.2 Scope of the Project and Site Description

- 2.2.1. The study area encompasses existing developments in Causeway Bay Typhoon Shelter as shown in *Figure 2.1*. The scope of the Project includes:
 - Temporary reclamation, which occupies about 0.7ha of Government foreshore and sea-bed (of which 0.3ha is already authorized under CWB project, i.e. additional reclamation of 0.4ha is required).
 - Dredging works at the southeast corner of the CBTS to provide space for temporary relocation of anchorage area due to the additional temporary reclamation for the Project.
 - Construction of a section of the twin track railway tunnel structure (approximately 160m long) above the proposed CWB located entirely offshore within the CBTS.
 - Relocation of the temporary Royal Hong Kong Yacht Club (RHKYC) jetty within the CWB temporary reclamation to a new location.

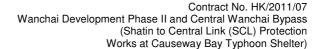

- Removal of the temporary reclamation, except the small area at the southwest corner
 of the reclamation (which will be removed by the SCL project upon completion of
 the future SCL tunnels connecting to the proposed South Ventilation Building
 (SOV)).
- 2.2.2. The Project contains Schedule 2 DP that, under the EIAO, requires Environmental Permits (EPs) to be granted by the DEP before they may either be constructed or operated. *Table 2.1* summarises the DP under this Project. *Figure 2.1* shows the location of this Schedule 2 DP.

Table 2.1 Schedule 2 Designated Projects under this Project

Item	Designated Project	EIAO Reference	Reason for inclusion
DP1	Temporary reclamation, which occupies about 0.7ha of Government foreshore and sea-bed	Schedule 2, Part I, C.12	A dredging operation which is less than 100m from a seawater intake point

2.3 Project Organization and Contact Personnel

- 2.3.1 Civil Engineering and Development Department and Highways Department are the overall project controllers for the construction phase of the Project, Project Engineer, Contractor(s), Environmental Team and Independent Environmental Checker are appointed to manage and control environmental issues.
- 2.3.2 The proposed project organization and lines of communication with respect to environmental protection works are shown in *Figure 2.2*. Key personnel and contact particulars are summarized in *Table 2.2*

Table 2.2 Contact Details of Key Personnel

Party	Role	Post	Name	Contact No.	Contact Fax
AECOM	Engineer's Representative for WDII	Principal Resident Engineer	Mr. Frankie Fan	2587 1778	2587 1877
	Engineer's Representative for CWB	Principal Resident Engineer	Mr. Peter Poon	3912 3388	3912 3010
MTR Corporation	Permit Holder	Environment Manager	Mr. Richard Kwan	2688 1179	2993 7577
Limited		Environmental Engineer I	Miss. Viola Tong	3127 6296	
		Environmental Engineer II	Mr. Chris Mak	3127 6297	
China State Construction Engineering (HK) Ltd.	Contractor under Contract no. HY/2009/15	Project Director	Mr. K C Cheung	3557 6399	2566 2192
		Site Manager	Mr. J H Chen	3557 6368	2566 2192
		Contractor's Representativ e	Mr. Andrew Wong	3557 6407	
		Head of construction	Mr. Roger Cheung	3557 6371	
		Environmental Officer	Mr. Daniel Sin	3557 6347	
ENVIRON Hong Kong Limited	Independent Environmental Checker (IEC)	Independent Environmental Checker (IEC)	Mr. David Yeung	3465 2888	3465 2899
Lam Geotechnics Limited	Environmental Team (ET)	Environmental Team Leader (ETL)	Mr. Raymond Dai	2882 3939	2882 3331

- 2.3.3 In this reporting period, the principal work activity is included as follows:
 - Trimmings works and tunnel structure works at ME4
- 2.3.4 In coming reporting month, the principal work activity is anticipated as follows:
 - Tunnel construction works at ME4

3 STATUS OF REGULATORY COMPLIANCE

3.1 Status of Environmental Licensing and Permitting under the Project

3.1.1. A summary of the current status on licences and/or permits on environmental protection pertinent to the Project is shown in *Table 3.1*.

Table 3.1 Summary of the current status on licences and/or permits on environmental protection pertinent to the Project

Permits and/or Licences	Reference No.	Issued Date	Status
Environmental Permit	EP-416/2011	4 April 2011	Valid
Further Environmental Permit	FEP-01/416/2011	11 Nov 2011	Valid

3.1.2. Summary of the current status on licences and/or permits on environmental protection pertinent and submission under FEP-01/416/2011 for contract no. HY/2009/15 showed in Table 3.2 and Table 3.3.

Table 3.2 Cumulative Summary of Valid Licences and Permits under Contract no. HY/2009/15

Permits and/or Licences	Reference No.	Issued Date	Valid Period/ Expiry Date	Status
Further Environmental Permit	FEP-01/416/2011	11 Nov 2011	N/A	Valid
Notification of Works Under APCO	321822	24 Sep 2010	N/A	Valid
Construction Noise Permit (CNP) for Pre-treatment, ELS and rock breaking works at TS4/ME4	GW-RS0705-13	28 Jun 2013	02 Jul 2013 to 31 Dec 2013	Valid
Registration as a Chemical Waste Producer	WPN: 5213-147- C1169-35	15 Nov 2010	N/A	Valid
Billing Account under Waste Disposal Ordinance	7011553	30 Sep 2010	27 Sep 2010 to 27 Jan 2016	Valid
Billing Account under Waste Disposal Ordinance (Dumping by Vessel)	7011761	25 Sep 2013	17 Oct 2013 to 16 Jan 2014	Valid
Water Discharge Licence (Discharge at TS4)	WT00011718- 2012	10 Jan 2013	10 Jan 2013 to 31 Jan 2014	Valid
Dumping Permit (Type 1 – Open Sea Disposal)	EP/MD/14-034	16 Jul 2013	24 Jul 2013 to 23 Jan 2014	Valid
Dumping Permit (Type 1 – Open Sea Disposal and Type 2 – Confined Marine Disposal)	EP/MD/14-093	19 Nov 2013	24 Nov 2013 to 23 Dec 2013	Valid

Table 3.3 Summary of submission status under EP/416/2011 and FEP-01/416/2011

EP Condition	FEP Condition	Submission	Date of Submission
2.3	2.1	Notification of setting up of ENPC	Submitted to EPD on 21 Nov 2011
2.4	-	Notification of setting up of CLG	Submitted to EPD on 21 Nov 2011
2.5	2.2	Notification of work commencement date	Submitted to EPD on 21 Oct 2011
2.5	-	Organization chart	Submitted to EPD on 17 Oct 2011
2.6	2.2	Work schedule and Location Plans	Submitted to EPD on 27 Oct 2011
2.7	2.3	Silt Curtain Deployment Plan	Re- submitted to EPD on 15 Dec 2011
2.8	2.4	Silt Screen Deployment Plan	Re- submitted to EPD on 15 Dec 2011
3.3	-	Baseline Monitoring Report	Submitted to EPD on 14 Nov 2011

4 Monitoring Requirements

4.1 Noise Monitoring

NOISE MONITORING STATIONS

4.1.1. The noise monitoring stations for the Project are listed and shown in *Table 4.1* and *Figure*2.3. Appendix 4.1 shows the established Action/Limit Levels for the monitoring works.

Table 4.1 Noise Monitoring Stations

Station	Description
M2b	Noon Gun Area

NOISE MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.1.2. The construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). $L_{eq~(30~minutes)}$ shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays. For all other time periods, $L_{eq~(5~minutes)}$ shall be employed for comparison with the Noise Control Ordinance (NCO) criteria. Supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 4.1.3. Noise monitoring shall be carried out at all the designated monitoring stations. The monitoring frequency shall depend on the scale of the construction activities. The following is an initial guide on the regular monitoring frequency for each station on a weekly basis when noise generating activities are underway:
 - One set of measurements between 0700 and 1900 hours on normal weekdays.

MONITORING EQUIPMENT

- 4.1.4. As referred to in the Technical Memorandum (TM) issued under the NCO, sound level meters in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications shall be used for carrying out the noise monitoring. Immediately prior to and following each noise measurement the accuracy of the sound level meter shall be checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Measurements may be accepted as valid only if the calibration level from before and after the noise measurement agree to within 1.0 dB.
- 4.1.5. Noise measurements shall not be made in fog, rain, wind with a steady speed exceeding 5 m/s or wind with gusts exceeding 10 m/s. The wind speed shall be checked with a portable wind speed meter capable of measuring the wind speed in m/s.



4.2 Air quality monitoring

AIR QUALITY MONITORING STATIONS

4.2.1. The air quality monitoring stations for the Project are listed and shown in *Table 4.2* and *Figure 2.3*. *Appendix 4.1* shows the established Action/Limit Levels for the monitoring works.

Table 4.2 Air quality monitoring Stations

Station ID	Monitoring Location	Description
СМАЗа	CWB PRE Site Office	Causeway Bay

AIR QUALITY MONITORING PARAMETERS, FREQUENCY AND DURATION

- 4.2.2. One-hour and 24-hour TSP levels should be measured to indicate the impacts of construction dust on air quality. The 24-hour TSP levels shall be measured by following the standard high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50), Appendix B.
- 4.2.3. All relevant data including temperature, pressure, weather conditions, elapsed-time meter reading for the start and stop of the sampler, identification and weight of the filter paper, and any other local atmospheric factors affecting or affected by site conditions, etc., shall be recorded down in detail.
- 4.2.4. For regular impact monitoring, the sampling frequency of at least once in every six-days, shall be strictly observed at all the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least three times in every six-days should be undertaken when the highest dust impact occurs.

SAMPLING PROCEDURE AND MONITORING EQUIPMENT

- 4.2.5. High volume samplers (HVSs) in compliance with the following specifications shall be used for carrying out the 1-hour and 24-hour TSP monitoring:
 - 0.6 1.7 m3 per minute adjustable flow range;
 - Equipped with a timing / control device with +/- 5 minutes accuracy for 24 hours operation;
 - Installed with elapsed-time meter with +/- 2 minutes accuracy for 24 hours operation;
 - Capable of providing a minimum exposed area of 406 cm2;
 - Flow control accuracy: +/- 2.5% deviation over 24-hour sampling period;
 - Equipped with a shelter to protect the filter and sampler;
 - Incorporated with an electronic mass flow rate controller or other equivalent devices;
 - Equipped with a flow recorder for continuous monitoring;
 - · Provided with a peaked roof inlet;
 - Incorporated with a manometer;
 - Able to hold and seal the filter paper to the sampler housing at horizontal position;
 - Easily changeable filter; and



- Capable of operating continuously for a 24-hour period.
- 4.2.6. Initial calibration of dust monitoring equipment shall be conducted upon installation and thereafter at bi-monthly intervals. The transfer standard shall be traceable to the internationally recognized primary standard and be calibrated annually. The concern parties such as IEC shall properly document the calibration data for future reference. All the data should be converted into standard temperature and pressure condition.

LABORATORY MEASUREMENT / ANALYSIS

- 4.2.7. A clean laboratory with constant temperature and humidity control, and equipped with necessary measuring and conditioning instruments to handle the dust samples collected, shall be available for sample analysis, and equipment calibration and maintenance. The laboratory should be HOKLAS accredited.
- 4.2.8. Filter paper of size 8" x 10" shall be labelled before sampling. It shall be a clean filter paper with no pinholes, and shall be conditioned in a humidity-controlled chamber for over 24-hours and be pre-weighed before use for the sampling.
- 4.2.9. After sampling, the filter paper loaded with dust shall be kept in a clean and tightly sealed plastic bag. The filter paper shall then be returned to the laboratory for reconditioning in the humidity controlled chamber followed by accurate weighing by an electronic balance with readout down to 0.1 mg. The balance shall be regularly calibrated against a traceable standard.
- 4.2.10. All the collected samples shall be kept in a good condition for 6 months before disposal.
- 4.2.11. Current calibration certificates of equipments are presented in Appendix 4.2.

4.3 Water Quality Monitoring

4.3.1. The EIA Report has identified that the key water quality impact would be associated with the dredging works during the construction phase. Marine water quality monitoring for dissolved oxygen (DO), suspended solid (SS) and turbidity is therefore recommended to be carried out at selected WSD flushing water intakes. The impact monitoring should be carried out during the proposed dredging works to ensure the compliance with the water quality standards.

Water Quality Monitoring Station

4.3.2. It is proposed to monitor the water quality at one cooling water intakes along the seafront of the Victoria Harbour. The proposed water quality monitoring stations of the Project are shown in *Table 4.3* and *Figure 2.3*. *Appendix 4.1* shows the established Action/Limit Levels for the monitoring works.

Table 4.3 Marine Water Quality Stations for Water Quality Monitoring

Cooling Water Intake					
Station ID	Monitoring Location	Easting	Northing		
C7	Windsor House	837193.7	816150.0		

WATER QUALITY PARAMETERS

- 4.3.3. Monitoring of dissolved oxygen (DO), turbidity and suspended solids (SS) shall be carried out at WSD flushing water intakes and cooling water intakes. DO and Turbidity are measured insitu while SS is determined in laboratory.
- 4.3.4. In association with the water quality parameters, other relevant data shall also be measured, such as monitoring location/position, time, sampling depth, water temperature, pH, salinity, dissolved oxygen (DO) saturation, weather conditions, sea conditions, tidal stage, and any special phenomena and work underway at the construction site etc.

SAMPLING PROCEDURES AND MONITORING EQUIPMENT

4.3.5. The interval between two sets of monitoring should not be less than 36 hours except where there are exceedances of Action and/or Limit Levels, in which case the monitoring frequency will be increased. *Table 4.4* shows the proposed monitoring frequency and water quality parameters. Duplicate in-situ measurements and water sampling should be carried out in each sampling event. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides should be not less than 0.5m.

Table 4.4 Marine Water Quality Monitoring Frequency and Parameters

Activities	Monitoring Frequency ¹	Parameters ²
During the 4-week baseline monitoring period	Three days per week, at mid- flood and mid-ebb tides	Turbidity, Suspended Solids (SS), Dissolved Oxygen (DO), pH, Temperature, Salinity
During marine construction works	Three days per week, at mid- flood and mid-ebb tides	Turbidity, Suspended Solids (SS), Dissolved Oxygen (DO), pH, Temperature, Salinity
After completion of marine construction works	Three days per week, at mid- flood and mid-ebb tides	Turbidity, Suspended Solids (SS), Dissolved Oxygen (DO), pH, Temperature, Salinity

Notes:

- 1. For selection of tides for in-situ measurement and water sampling, tidal range of individual flood and ebb tides should be not less than 0.5m.
- 2. Turbidity should be measured in situ whereas SS should be determined by laboratory.



DISSOLVED OXYGEN AND TEMPERATURE MEASURING EQUIPMENT

- 4.3.6. The instrument should be a portable, weatherproof dissolved oxygen measuring instrument complete with cable, sensor, comprehensive operation manuals, and use a DC power source. It should be capable of measuring:
 - a dissolved oxygen level in the range of 0-20 mg/l and 0-200% saturation
 - a temperature of 0-45 degree Celsius
- 4.3.7. It should have a membrane electrode with automatic temperature compensation complete with a cable. Sufficient stocks of spare electrodes and cables should be available for replacement where necessary. (e.g. YSI model 59 meter, YSI 5739 probe, YSI 5795A submersible stirrer with reel and cable or an approved similar instrument).
- 4.3.8. Should salinity compensation not be build-in in the DO equipment, in-situ salinity shall be measured to calibrate the DO equipment prior to each DO measurement.

TURBIDITY MEASUREMENT INSTRUMENT

4.3.9. The instrument should be a portable, weatherproof turbidity-measuring instrument complete with comprehensive operation manual. The equipment should use a DC power source. It should have a photoelectric sensor capable of measuring turbidity between 0-1000 NTU and be complete with a cable (e.g. Hach model 2100P or an approved similar instrument).

SAMPLER

4.3.10. A water sampler comprises a transparent PVC cylinder, with a capacity of not less than 2 litres, and can be effectively sealed with latex cups at both ends. The sampler should have a positive latching system to keep it open and prevent premature closure until released by a messenger when the sampler is at the selected water depth (e.g. Kahlsico Water Sampler or an approved similar instrument).

SAMPLE CONTAINER AND STORAGE

4.3.11. Water samples for suspended solids measurement should be collected in high-density polythene bottles, packed in ice (cooled to 4°C without being frozen), and delivered to ALS Technichem (HK) Pty Ltd. as soon as possible after collection for analysis.

WATER DEPTH DETECTOR

4.3.12. A portable, battery-operated echo sounder shall be used for the determination of water depth at each designated monitoring station. This unit can either be handheld or affixed to the bottom of the workboat, if the same vessel is to be used throughout the monitoring programme.

SALINITY

4.3.13. A portable salinometer capable of measuring salinity in the range of 0-40 ppt shall be provided for measuring salinity of the water at each of monitoring location.

MONITORING POSITION EQUIPMENT

4.3.14. A hand-held or boat-fixed type digital Global Positioning System (GPS) with waypoint bearing indication or other equivalent instrument of similar accuracy shall be provided and used during monitoring to ensure the monitoring vessel is at the correct location before taking measurements.

CALIBRATION OF IN-SITU INSTRUMENTS

- 4.3.15. All in-situ monitoring instrument shall be checked, calibrated and certified by a laboratory accredited under HOKLAS or equivalent before use, and subsequently re-calibrated at 3 monthly intervals throughout all stages of the water quality monitoring. Responses of sensors and electrodes should be checked with certified standard solutions before each use. Wet bulb calibration for a DO meter shall be carried out before measurement at each monitoring location.
- 4.3.16. For the on site calibration of field equipment by the ET, the BS 127:1993, "Guide to Field and on-site test methods for the analysis of waters" should be observed.
- 4.3.17. Sufficient stocks of spare parts should be maintained for replacements when necessary. Backup monitoring equipment shall also be made available so that monitoring can proceed uninterrupted even when some equipment is under maintenance, calibration, etc.
- 4.3.18. Current calibration certificates of equipments are presented in *Appendix 4.2*.

LABORATORY MEASUREMENT / ANALYSIS

4.3.19. Analysis of suspended solids has been carried out in a HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd. Water samples of about 1L shall be collected at the monitoring stations for carrying out the laboratory SS determination. The SS determination work shall start within 24 hours after collection of the water samples. The SS determination shall follow APHA 19ed or equivalent methods subject to the approval of IEC and EPD.



5 MONITORING RESULTS

- 5.0.1. Overall layout showing work area, latest status of work commencement and monitoring stations is shown in *Figure 2.1* and *Figure 2.3*.
- 5.0.2. The environment monitoring schedules for reporting month and coming month are presented in *Appendix 5.1*.

5.1 Noise Monitoring Results

The noise monitoring station is shown in *Table 5.1* below.

Table 5.1 Noise Monitoring Station

Station	Description
M2b	Noon Gun Area

5.1.1 No exceedance was recorded in the reporting month. Noise monitoring results in this reporting period are reviewed and summarized. Details of noise monitoring results and graphical presentation can be referred in *Appendix 5.2*

5.2 Air quality monitoring Results

The air quality monitoring station is shown in *Table 5.2* below.

Table 5.2 Air quality monitoring Station

Station	Description
СМАЗа	CWB PRE Site Office

5.2.2 No exceedance was recorded in the reporting month. Air quality monitoring results in this reporting period are reviewed and summarized. Details of air quality monitoring results and graphical presentation can be referred in *Appendix 5.3.*

5.3 Water quality monitoring Results

5.3.1 The water quality monitoring station is summarized in *Table 5.3* below.

Table 5.3 Water quality monitoring Station

Station Ref.	Location	Easting	Northing		
Cooling Water Intake					
C7	Windsor House	837193.7	816150.0		

5.3.2 The DO level at C7 were monitored during the construction period to avoid aggravation of odour nuisance from seawater arising from temporary reclamation in the CBTS in the reporting month. One action level DO exceedance was recorded, and no odour complaint was received in the reporting period.

Lam Geotechnics Limited

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

- 5.3.3 Water quality monitoring location at C7 was finely adjusted to the outside of the inner silt curtain frame since 31 Dec 2012.
- 5.3.4 One action level DO exceedance was recorded on 25 November 2013 during flood tide. After investigation, the exceedance was considered not related to Project works.
- 5.3.5 Water quality monitoring results measured in this reporting period are reviewed and summarized. Details of water quality monitoring results and graphical presentation can be referred in Table 5.4 and *Appendix 5.4*.

Table 5.4 Summary of Water Quality Monitoring Exceedance in Reporting Month

Contract no. Water quality monitoring Station		Mid-flood				Mid-ebb							
	DO Turbidity		SS		DO		Turbidity		SS				
	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	
HY/2009/15	C7	1	0	0	0	0	0	0	0	0	0	0	0
Total		1	0	0	0	0	0	0	0	0	0	0	0

5.4 Waste Monitoring Results

5.4.1. Inert C&D wastes were disposed of in this reporting month. Details of the waste flow table are summarized in *Table 5.5*.

Table 5.5 Details of Waste Disposal

Waste Type	Quantity this month	Cumulative Quantity-to-Date	Disposal / Dumping Grounds	Remarks
Inert C&D	NIL	32,670	TM38	N/A
materials disposed, m3	NIL	6,267	TKO137	
	NIL	25,395.7	TS2	N/A
Inert C&D	NIL	1,228	WDII	
materials	NIL	1416	Lun Ku Tan	
recycled, m3	NIL	352	WENT Landfill	
	NIL	1,049	HY/2011/03 (HZM)	
Non-inert C&D materials disposed, m3	NIL	NIL	N/A	N/A
Non-inert C&D materials recycled, m3	NIL	NIL	N/A	N/A
Chemical waste disposed, kg	NIL	NIL	N/A	N/A
Marine Sediment	NIL	10,640	Cheung Chau	Dredging from
(Type 1 – Open Sea Disposal) , m3	(Bulk Volume)	(Bulk Volume)	South	SCL Protection Works (CBTS)
Marine Sediment	NIL	7,500	East of Sha Chau	Dredging from
(Type 1 – Open Sea Disposal (Dedicate Sites) & Type 2 – Confined Marine Disposal) , m3	(Bulk Volume)	(Bulk Volume)		SCL Protection Works (CBTS)
Marine Sediment (Type 3 – Special Treatment / Disposal contained in geosynthetic Containers), m3	NIL	NIL	N/A	N/A

6 Compliance Audit

6.0.1. The Event Action Plan for construction noise, air qualities are presented in Appendix 6.1.

6.1 Noise Monitoring

6.1.1. No action and limit exceedance was recorded in the reporting month.

6.2 Air quality monitoring

6.2.1 No action and limit exceedance was recorded in the reporting month.

6.3 Water quality monitoring

6.3.1 One action level DO exceedance was recorded at C7 in this reporting month. The exceedance was considered not related to project works.

6.4 Review of the Reasons for and the Implications of Non-compliance

6.4.1. There was no non-compliance from the site audits in the reporting period. The observations and recommendations made in each individual site audit session were presented in Section 8.

6.5 Summary of action taken in the event of and follow-up on non-compliance

6.5.1 There was no particular action taken since no project-related non-compliance was recorded from the site audits and environmental monitoring in the reporting period.

7 Cumulative Construction Impact due to the Concurrent Projects

- 7.0.1. According to Condition 3.4 of the EP-416/2011, this section addresses the relevant cumulative construction impact due to the concurrent activities of the current projects including the Wan Chai Development Phase II (WDII) and Central-WanChai Bypass (CWB).
- 7.0.2. From the Monthly EM&A report (October 2013) of Wan Chai Development Phase II (WDII) the key works in November 2013 are as follows:

<u>Contract no. HK/2009/01 - Wan Chai Development Phase II - Central -Wanchai Bypass at HKCEC</u>

Marine Works

- Filling works up to +4.0mPD between CH360 to CH370.
- Construction of RC structure proposed box culvert Bay 8 Wall and Bay 9 Base slab.
- D-wall construction at Stage 3.
- Outfall construction for discharge pipes at Expo Drive East.

Cooling Watermains, Salt Watermains and Sewer (On Land)

- Salt watermain laying works would be continued along west of Convention Avenue to Fenwick Pier Street in Zone A3-5C, A3-1, A3-5B, A2-4A, A5-5 & A5-2 and at Convention Avenue near Grand Hyatt hotel in Zone A1-5C, A1-5B & A1-5A3.
- Road advance works at the junction between Expo Drive East & Expo Drive Central and nearby area.
- Cooling main laying works along Expo Drive East to Fleming Road for BF, BI & BG discharge system.

Tunnel Works

- Installation of pre-bored H-pile in CWB Stage 2 Atrium Link.
- Construction of the south Common D-wall.
- Advance works for demolition of the HKCEC Pump home.
- ELS for Stage 1 CWB.



<u>Contract no. HK/2009/02 - Wan Chai Development Phase II – Central – Wan Chai Bypass at WanChai East</u>

- 60-day trial operation of P7 cooling water system.
- Leakage rectification works for P8 discharge mains at Ex-Pet Garden.
- Flexible joint rectification works for P8 discharge mains at CHBH152m.
- Hatch box replacement for P7 intake mains.
- Butterfly valve dismantling works for P7, P8 and P9 system.
- All outstanding works for handing over P7, P8 and P9 Cooling Water Pumping Stations.
- Connection with the existing DN600 salt watermains at Hung Hing Road.
- Water tightness test for Salt Water Intake Culvert.
- Removal of temporary bulkhead for commencement of wet test of the WSD Salt Water Pumping Station.
- Outstanding works at WSD Salt Water Pumping Station.
- Box Culvert N1 & Drain FRP-N and handed over to DSD
- Drainage re-diversion from temp 1800 dia. drain to the completed Box Culvert N1.
- ABWF works in Ferry Pier.
- Rectifying defects in movable ramp.
- Most of the individual T&C of E&M equipment at Ferry Pier
- Installation works for FRP Enclosure at 1/F public area, 2/F and staircase in Ferry Pier.
- Utility works and commence EVA construction extending from P7 Cooling Water Pumping Station to the Ferry Pier.
- All outstanding interface coring for Eastern Bulkhead for substantial completion of Section IXA of the Works.
- Filling works at WCR4/TWCR4 after abandonment of existing temp 1800 dia. drain at WCR4.
- Backfilling and roadworks at Hung Hing Road & Wan Shing Street for successful implementation of HHR Flyover Diversion (Stage 1) on 2 Nov 2013

<u>Contract no. HY/2009/15 - Central-Wanchai Bypass - Tunnel (Causeway Bay Typhoon Shelter Section)</u>

· Construction of EVA

<u>Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass</u> over MTR Tsuen Wan Line

· Sheet piling works

Contract no. HY/2009/19 - Central- Wan Chai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link

- D-wall and Barrette Construction
- Removal of strut at ELS
- Construction works for Box Culvert T1
- Removal of marine platform
- Construction of pile cap, pier & cross head (Marine)
- ELS and Cut & Cover Tunnel
- Installation of dewatering well
- Launching of segments
- Extraction of temporary pile from marine section
- Construction of bridge truss TA1
- · Demolition of parapet at IEC link
- Construction of King Post at ELS

Construction of King Post at ELSContract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West

- Site survey
- Dredging
- ELS for box culvert L at Lung King Street
- · Works for abandoning watermains at Lung King Street
- · Caisson seawall units installation and marine filling

Contract no. HY/2010/08 - Central - Wan Chai Bypass (CWB) - Tunnel (Slip Road 8)

- Nil
- 7.0.3. From the Monthly EM&A report (October 2013) of Central-Wan Chai Bypass (CWB) the key works in November 2013 are as follows:

Contract no. HY/2009/18 - Central - Wan Chai Bypass (CWB) - Central Interchange under FEP-05/364/2009/A

- Excavation of trial pit
- Drainage works
- Tunnel works including scaffolding erection, excavation, OHVD installation, roadside barriers, top and base slab construction, extract sheet pile, waterproofing and backfill
- Trough structure construction and associated drilling and grouting
- Road works
- Bridges construction

Contract no. HK/2009/01 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Hong Kong Convention and Exhibition Centre - Tunnel Works under FEP-02/364/2009

- Installation of pre-bored H-pile in CWB Stage 2 Atrium Link.
- Construction of the south Common D-wall.
- Advance works for demolition of the HKCEC Pump home.
- ELS for Stage 1 CWB.

Contract no. HK/2009/02 - Wan Chai Development Phase II - Central - Wan Chai Bypass at Wan Chai East (CWB Tunnel) under FEP-01/364/2009

- Removal of Strut S4
- False work erection for OHVD base slab construction at Tunnel Portion 1.
- Upper wall construction for Southern Side Wall Bay 4-Bay 7
- D-Wall construction (Stage 1) at Tunnel Portion 2.
- Plant setup for D-Wall construction at Portion 9 of the Site. (Done by HK/2009/01 contractor)
- D-Wall construction at Tunnel Portion 6.

<u>Contract no. HY/2009/15 - Central-Wanchai Bypass - Tunnel (Causeway Bay Typhoon Shelter Section) under FEP-06/364/2009/A</u>

- ELS works, water proofing and tunnel construction at TS4
- Cut and cover tunnel construction at TPCWAE
- Excavation, installation of steel ribs and tunnel lining construction for mined tunnel
- ELS works at TS2

Contract no. HY/2009/19 - Central - Wanchai Bypass Tunnel (North Point Section) and Island Eastern Corridor Link under FEP-07/364/2009/A

- Road works at Watson Road
- Bored piling (Land)
- D-wall and Barrette Construction
- Removal of strut at ELS
- Construction works for Box Culvert T1
- Construction of Pile cap (Land)
- Removal of marine platform
- Construction of pile cap, pier & cross head (Marine)
- ELS and Cut & Cover Tunnel
- Installation of dewatering well
- Launching of segments
- Extraction of temporary pile from marine section
- Construction of bridge truss TA1
- Demolition of parapet at IEC link
- Construction of King Post at ELS
- Construction of King Post at ELS will commence

Contract no. HK/2010/06 - Wan Chai Development Phase II - Central - Wan Chai Bypass over MTR Tsuen Wan Line under FEP-08/364/2009/A

- Stitching Works
- Grouting Works
- Filling works

<u>Contract no. HK/2012/08 – Wan Chai Development Phase II – Central- Wan Chai Bypass at Wan Chai West under FEP-09/364/2009B</u>

- Site preparation works
- Site survey

Contract no. HY/2010/08 -Central - Wan Chai Bypass (CWB) -Tunnel (Slip Road 8) under FEP-10/364/2009B

- Tree Pruning works
- Tree removal works,
- Tree transplanting works,
- · Tree works within off-site nursery compound,
- Instrumentation works,
- Ground investigation works
- Sheet piling and
- · Erection of site hoarding.
- 7.0.4. According to the construction programme of Wan Chai Development Phase II, Central-Wan Chai Bypass and Island Eastern Corridor Link projects, the major construction activity under Wan Chai Development Phase II were marine works at HKCEC areas, cross-harbour Watermains, Fresh Watermains and Cooling Watermains Installations, tunnel works at Wan Chai East. The major construction activities under Central-Wan Chai Bypass and Island Eastern Corridor Link Projects were ELS work and tunnel water proofing works at TS4 and cut and cover tunnel construction at TPCWAE. Bridge construction and tunnel works at Central Interchange, ELS segment launching works and IEC parapet demolition at North Point area. The major environmental impact was water quality impact at Causeway Bay and Wan Chai. Land-based construction activities were excavation at TS2, ELS work and tunnel water proofing works at TS4, cut and cover tunnel construction at TPCWAE, tunnel works at Central and ELS work at North Point and tunnel works at Wan Chai East in the reporting month.

8 Environmental Site Audit

- 8.0.1. During this reporting period, weekly environmental site audits were conducted for the SCL Protection Works under the Contract no. HY/2009/15. No non-conformance was identified during the site audits.
- 8.0.2. Five site inspections for Contract no. HY/2009/15 was carried out during this reporting period. No finding was observed during the reporting period.

9 COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTION

- 9.0.1. There was no environmental complaint and prosecution recorded in the reporting period.
- 9.0.2. The details of cumulative complaint log and updated summary of complaints are presented in *Appendix 9.1*
- 9.0.3. Cumulative statistic on complaints and successful prosecutions are summarized in *Table 9.1* and *Table 9.2* respectively.

Table 9.1 Cumulative Statistics on Complaints

Reporting Period	No. of Complaints
November 2013	0
November 2011 to October 2013	0
Total	0

Table 9.2 Cumulative Statistics on Successful Prosecutions

Environmental Parameters	Cumulative No. Brought Forward	No. of Successful Prosecutions this period (Offence Date)	Cumulative No. Project-to-Date
Air	-	0	0
Noise	-	0	0
Water	-	0	0
Waste	-	0	0
Total	-	0	0

10. CONCLUSION


- 10.0.1. The EM&A programme was carried out in accordance with the EM&A Manual requirements, minor alternations to the programme proposed were made in response to changing circumstances.
- 10.0.2. The scheduled construction activities and the recommended mitigation measures for the coming month are listed in *Table 10.1*. The construction programmes of individual contracts are provided in *Appendix 10.1*.

Table 10.1 Summary of Key Construction Activities of Individual Contract(s) to be commenced in Coming Reporting Month

Contract No.	Key Construction Works	Recommended Mitigation Measures
HY/2009/15	 Tunnel construction works at ME4 	Watering for any dust or exposed surface

Figure 2.1

Project Layout

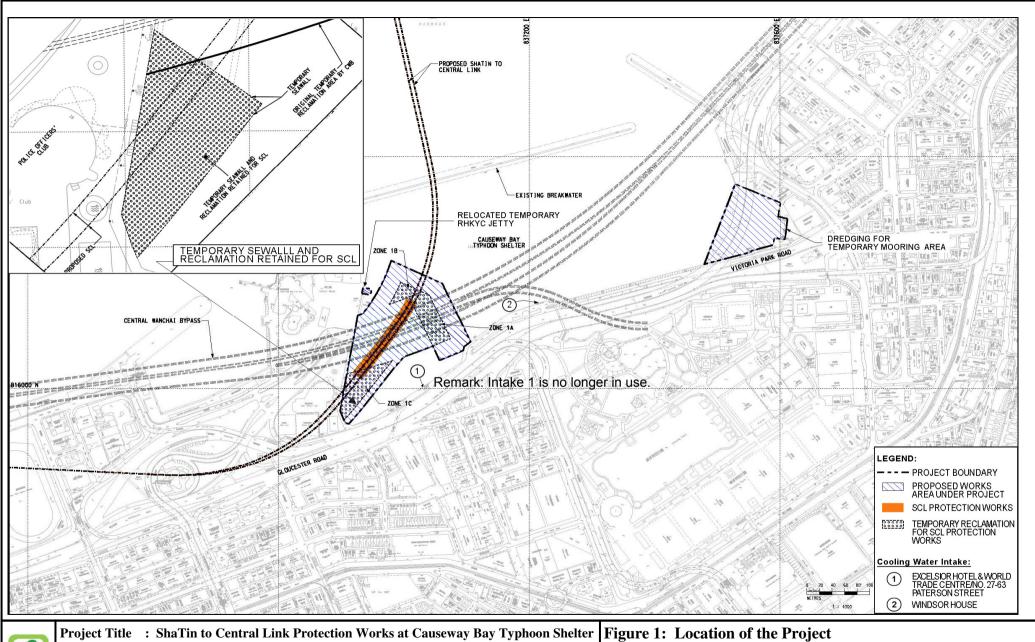



工程項目名稱:沙田至中環綫位於銅鑼灣避風塘內之保護工程

Environmental Permit No.: EP-416/2011 環境許可證編號 : EP-416/2011

1: 工程項目位置

(This figure was prepared based on Figure NEX2213/C/331/ENS/M50/501 of EIA report (Register No.: AEIAR-159/2011))

(本圖是根據環評報告(登記冊編號 AEIAR-159/2011)圖 NEX2213/C/331/ENS/M50/501 編制)

Figure 2.2

Project Organization Chart

Project Organization Chart


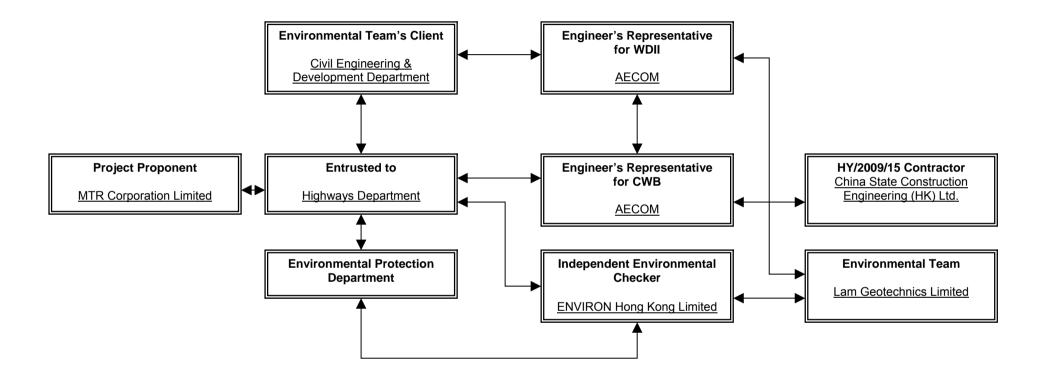


Figure 2.3

Locations of Monitoring Stations

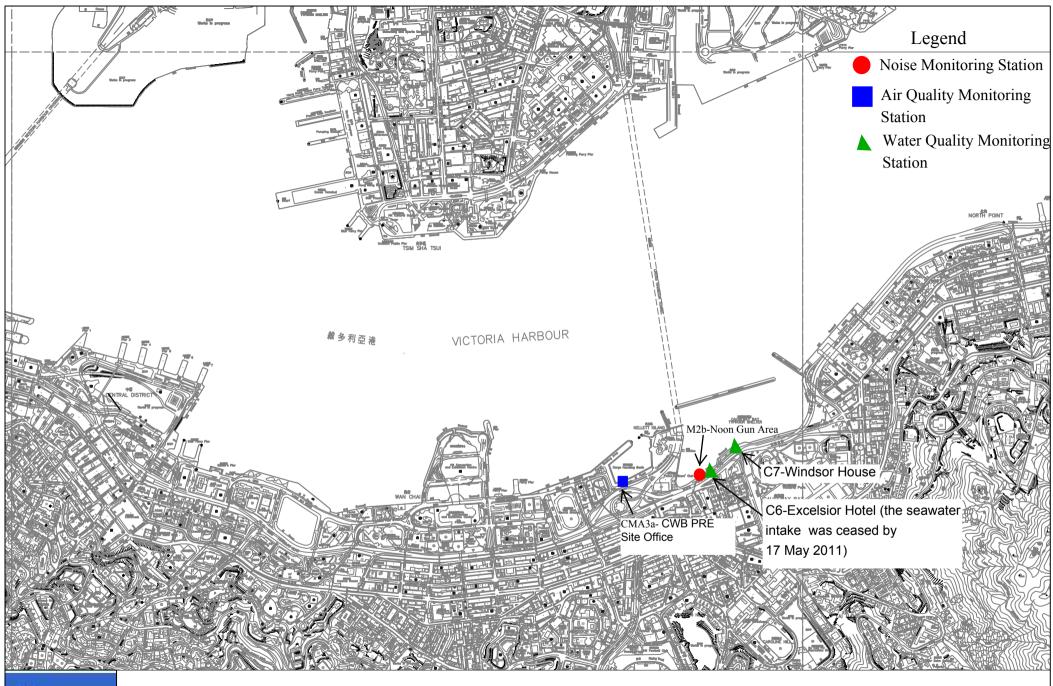

am

Location Plan of Monitoring Stations

Appendix 3.1

Environmental Mitigation Implementation Schedule

Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

IMPLEMENTATION SCHEDULE OF THE PROPOSED MITIGATION MEASURES

EIA Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concern to Address	Who to implement the measures?	Location of the measure	When to implement the measures?	What requirements or standards for the measure to achieve?
	uality Impact (Construction Phase)					
3.142	Dredging should be carried out by closed grab dredger.	To minimize release of sediment and contaminants during dredging.	Contractor	Dredging works areas in Causeway Bay Typhoon Shelter (CBTS)	Construction Phase	EIAO-TM, WPCO
S3.142	All temporary reclamation works should adopt an approach where temporary seawalls will first be formed to enclose each phase of the temporary reclamation. Installation of diaphragm wall on temporary reclamation as well as any bulk filling will proceed behind the completed seawall. Any gaps that may need to be provided for marine access should be shielded by silt curtains to control sediment plume dispersion away from the site. Demolition of temporary reclamation including the demolition of the diaphragm wall and dredging to the existing seabed levels	To minimize loss of fines and contaminants during temporary reclamations	Contractor	Temporary reclamation works areas in CBTS	Construction Phase	EIAO-TM, WPCO

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	should be carried out behind the temporary seawall. Temporary seawall should be removed after completion of all excavation and dredging works for demolition of the temporary reclamation.					
S3.142	During construction of the temporary reclamation, temporary seawall should be partially constructed to protect the nearby seawater intakes from further dredging activities. For example, the seawalls along the southeast and northeast boundaries of PW1.1 should be constructed first (above high water mark) so that the seawater intake at the inner water would be protected from the impacts from the remaining dredging activities along the northwest boundary.	To minimize water quality impact upon the cooling water intakes in CBTS from temporary reclamation works	Contractor	Temporary reclamation works areas in CBTS	onstruction Phase	EIAO-TM, WPCO
S3.142	Silt curtains should be deployed to fully enclose the closed grab dredger during any dredging operation within the CBTS.	To minimize loss of fines and contaminants during dredging in CBTS	Contractor	Dredging works areas in CBTS	Construction Phase	EIAO-TM, WPCO
S3.142	Silt screens will be installed at all the cooling water intakes within the CBTS during temporary reclamation and dredging within the typhoon shelter.	To minimize water quality impact upon the cooling water intakes in CBTS from marine construction activities	Contractor	Cooling water intakes inside CBTS	Construction Phase	EIAO-TM, WPCO
S3.143	No more than two closed grab dredgers should be operated for dredging within the CBTS at	To minimize loss of fines and contaminants	Contractor	Temporary reclamation and	Construction Phase	EIAO-TM, WPCO

	any time. Moreover, the combined production rate of all concurrent dredging works to be undertaken within the CBTS shall not exceed 6,000 m ₃ per day at all times throughout the	during dredging in CBTS		dredging works areas in CBTS		
S3.145	entire construction period. The following good site practices should be undertaken during sand filling, public filling and dredging: • mechanical grabs, if used, should be designed and maintained to avoid spillage and sealed tightly while being lifted. For dredging of any contaminated mud, closed watertight grabs must be used; • all vessels should be sized so that adequate clearance is maintained between vessels and the seabed in all tide conditions, to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; • all hopper barges and dredgers should be fitted with tight fitting seals to their bottom openings to prevent leakage of material; • construction activities should not cause foam, oil, grease, scum, litter or other objectionable matter to be present on the water within the	To minimize loss of fines and contaminants from dredging / filling	Contractor	Temporary reclamation and dredging works areas in CBTS	Construction Phase	EIAO-TM, WPCO

	site or dumping grounds; and • loading of barges and hoppers should be controlled to prevent splashing of dredged material into the surrounding water. Barges or hoppers should not be filled to a level that will cause the overflow of materials or polluted water during loading or transportation.					
S3.146	The following mitigation measures are proposed to minimize the potential water quality impacts from the construction works at or close to the seafront: • Temporary storage of construction materials (e.g. equipment, filling materials, chemicals and fuel) and temporary stockpile of construction and demolition materials should be located well away from the seawater front and storm drainage during carrying out of the works. • Stockpiling of construction and demolition materials and dusty materials should be covered and located away from the seawater front and storm drainage. • Construction debris and spoil should be covered up and/or disposed of as soon as	To minimize release of construction wastes from construction works at or close to the seafront	Contractor	Construction works at or close to the seafront	Construction Phase	EIAO-TM, WPCO

	possible to avoid being washed into the nearby receiving waters.					
S3.147	Silt curtains should be installed around the working area for the marine piling works for construction of the temporary jetty as necessary to minimize the release of sediment and construction wastes. All wastewater generated from the piling activities should be collected by a derrick lighter or other collection system and be treated before controlled discharge. Spoil from the piling activities should be collected by sealed hopper barges for proper disposal.	To minimize water quality impacts from piling works for construction of the temporary jetty	Contractor	Piling area at the piling location	Construction Phase	EIAO-TM, WPCO
S3.148	Regular maintenance of and refuse collection should be performed at the silt screens deployed at the seawater intakes at regular intervals on a daily basis. The Contractor should be responsible for keeping the water behind the silt screen free from floating rubbish and debris during the impact monitoring period.	To avoid the pollutant and refuse entrapment problems at the silt screens to be installed at the water intakes	Contractor	Proposed silt screens at cooling water intakes inside CBTS	Construction Phase	EIAO-TM, WPCO
S3.149	It is recommended that collection and removal of floating refuse should be performed within the marine construction areas at regular intervals on a daily basis. The Contractor should be	To minimize water quality impacts from illegal dumping and littering from marine vessels and runoff from	Contractor	All marine works areas	Construction Phase	EIAO-TM, WPCO, WDO

	responsible for keeping the water within the site boundary and the neighbouring water free from rubbish during the dredging works.	the coastal areas				
S3.150 to 3.169	The site practices outlined in ProPECC PN 1/94 "Construction Site Drainage" should be followed where practicable.	To minimize water quality impacts from construction site runoff and general construction activities	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO, ProPECC PN 1/94
S3.170	There is a need to apply to EPD for a discharge licence for discharge of effluent from the construction site under the WPCO. The discharge quality must meet the requirements specified in the discharge licence. All the runoff and wastewater generated from the works areas should be treated so that it satisfies all the standards listed in the TM-DSS. Minimum distances of 100 m should be maintained between the discharge points of construction site effluent and the existing seawater intakes. The beneficial uses of the treated effluent for other on-site activities such as dust suppression, wheel washing and general cleaning etc., can minimise water consumption	To minimize water quality impact from effluent discharges from construction sites	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM-DSS

	and reduce the effluent discharge volume. If monitoring of the treated effluent quality from the works areas is required during the construction phase of the Project, the monitoring should be carried out in accordance with the WPCO license which is under the ambit of Regional Office (RO) of EPD.					
\$3.171 & 3.172	Construction work force sewage discharges on site are expected to be connected to the existing trunk sewer or sewage treatment facilities. If disposal of sewage to public sewerage system is not feasible, appropriate numbers of portable toilets shall be provided by a licensed contractor to serve the construction workers over the construction site to prevent direct disposal of sewage into the water environment. The Contractor shall also be responsible for waste disposal and maintenance practices. Notices should be posted at conspicuous locations to remind the workers not to discharge any sewage or wastewater into the nearby environment.	To minimize water quality impacts due to sewage generated from construction workforce	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO
S3.173	Contractor must register as a chemical waste producer if	To minimize water quality	Contractor	All construction	Construction Phase	EIAO-TM, WPCO, TM-

	chemical wastes would be produced from the construction activities. The Waste Disposal Ordinance (Cap 354) and its subsidiary regulations in particular the Waste Disposal (Chemical Waste) (General) Regulation should be observed and complied with for control of chemical wastes.	impact from accidental spillage of chemical		works areas		DSS, WDO
S3.174	Any service shop and maintenance facilities should be located on hard standings within a bunded area, and sumps and oil interceptors should be provided. Maintenance of vehicles and equipment involving activities with potential for leakage and spillage should only be undertaken within the areas appropriately equipped to control these discharges.	To minimize water quality impact from accidental spillage of chemical	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO
S3.175	Disposal of chemical wastes should be carried out in compliance with the Waste Disposal Ordinance. The "Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes" published under the Waste Disposal Ordinance details the requirements to deal with chemical wastes. General requirements are given as follows: • Suitable containers should	To minimize water quality impact from accidental spillage of chemical	Contractor	All construction works areas	Construction Phase	EIAO-TM, WPCO, TM- DSS, WDO

	be used to hold the chemical wastes to avoid leakage or spillage during storage, handling and transport. • Chemical waste containers should be suitably labelled, to notify and warn the personnel who are handling the wastes, to avoid accidents. • Storage area should be selected at a safe location on site and adequate space should be allocated to the storage area.					
S4. 30	The following good site practices should be implemented: • Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction program • Silencers or mufflers on construction equipment should be utilized and should be properly maintained during the construction program • Mobile plant, if any, should be sited as far from NSRs as possible • Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum	To reduce construction noise impact	Contractor	All works areas	Construction phase	EIAO-TM, NCO

Contract No. HK/2011/07

Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

	 Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs Material stockpiles and other structures should be effectively utilized, wherever practicable, in screening noise from on-site construction activities. 					
S4.31 – S4.32 & Table 4.7	The following quiet PME are recommended for the construction activities: Air Compressor Bulldozer Concrete Pump Concrete Lorry Mixer Crane Dump Truck Excavator Generator Hand-held Breaker Poker Vibrator Roller Trucks	To reduce construction noise impact	Contractor	All works areas	Construction phase	EIAO-TM, NCO
S4.33 – S4.35 & Table 4.8	Movable noise barrier should be used for following PME: Air Compressor Bar Bender Bentonite Plants Concrete pump Diaphragm Wall Rigs Excavator	theo reduce construction noise impact	Contractor	Affected works areas showing exceedance during un- mitigated scenario	Construction phase	EIAO-TM, NCO

	Poker Vibrator					
_						
	ction Dust Impact					T
S5.43	Watering once on construction areas for every working hour	To minimize dust impact	Contractor	Temporary reclamation area in CBTS	Construction phase	APCO
S5.43	Covering/paving the southwest retained area of temporary reclamation once filling is completed	To minimize dust impact	Contractor	southwest retained area of temporary reclamation	Construction phase	phase APCO
S5.44	Dust suppression measures stipulated in the Air Pollution Control (Construction Dust) Regulation and good site practices: Use of regular watering, with complete coverage, to reduce dust emissions from exposed site surfaces and unpaved roads, particularly during dry weather. Use of frequent watering for particularly dusty cons truction areas and areas close to ASRs. Side enclosure and covering of any aggregate or dusty material storage piles to reduce emissions. Where this is not practicable owing to frequent usage, watering shall be applied to aggregate fines.	To minimize dust impacts	Contractor	Temporary reclamation area in CBTS	Construction phase	APCO and Air Pollution Control (Construction Dust) Regulation

		1	T	-
Open stockpiles shall be				
avoided or covered. Where				
possible, prevent placing dusty				
material storage piles near				
ASRs.				
Tarpaulin covering of all				
dusty vehicle loads transported				
to, from and between site				
locations.				
Establishment and use of				
vehicle wheel and body				
washing facilities at the exit				
points of the site.				
Provision of wind shield and				
dust extraction units or similar				
dust mitigation measures at the				
loading points, and use of				
water sprinklers at the loading				
area where dust generation is				
likely during the loading				
process of loose material,				
particularly in dry seasons/				
periods.				
Provision of not less than				
2.4m high hoarding from				
ground level along site				
boundary where adjoins a road,				
streets or other accessible to				
the public except for a site				
entrance or exit.				
Imposition of speed controls				
for vehicles on site haul roads.				
Where possible, routing of				
vehicles and positioning of				
construction plant should be at				
the maximum possible distance				
from ASRs.				
				_

Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection

Works at Causeway Bay Typhoon Shelter)

bags pulve shoul imper in an and t In envir auditi consi enfor meth condi	rery stock of more than 20 of cement or dry rised fuel ash (PFA) d be covered entirely by rvious sheeting or placed area sheltered on the top he 3 sides. stigation of an commental monitoring and ng program to monitor the rruction process in order to ce controls and modify od of work if dusty tions arise. ent implications (Construction Ph	ase)				
6.62 Good Waste - Pree Mana the E Office curre const - Trai site comana hand - Production - App mining dust of waste or by enclo	d Site Practices and the Reduction Measures to the Project based on the project based on the practices on the project based on the practices, which is the personnel in, the project based on the project	To enhance water management practice and achieve waste reduction.	Contractor	All Work Sites	Construction Phase	Waste Disposal Ordinance (Cap. 354) Land (Miscellaneous Provisions) Ordinance (Cap. 28) ETWB TC(W) No.31/2004

	maintenance programme for drainage systems, sumps and oil interceptors; and - Separation of chemical wastes for special handling and appropriate treatment.					
6.63	Good Site Practices and Waste Reduction Measures (con't) - Sorting of demolition debris and excavated materials from demolition works to recover reusable/ recyclable portions (i.e. soil, broken concrete, metal etc.); - Segregation and storage of different types of waste in different containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal; - Encourage collection of aluminum cans by providing separate labeled bins to enable this waste to be segregated from other general refuse generated by the workforce; - Proper storage and site practices to minimize the potential for damage or contamination of construction materials; - Plan and stock construction	To achieve waste reduction	Contractor	All Work Sites	Construction Phase	Waste Disposal Ordinance (Cap. 354) Land (Miscellaneous Provisions) Ordinance (Cap. 28)

Contract No. HK/2011/07
Wanchai Development Phase II and Central Wanchai Bypass

EM&A Report for Shatin to Central Link Protection Works at Causeway Bay Typhoon SHelter

(Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

	materials carefully to minimize amount of waste generated and avoid unnecessary generation of waste; and - Training should be provided to workers about the concepts of site cleanliness and appropriate waste management procedures, including waste reduction, reuse and recycle.					
6.64	Good Site Practices and Waste Reduction Measures (con't) - The Contractor shall prepare and implement an EMP in accordance with ETWB TCW No. 19/2005. Such management plan should incorporate site specific factors, such as the designation of areas for segregation and temporary storage of reusable and recyclable materials. The EMP should be submitted to the Engineer for approval. The Contractor should implement the waste management practices in the EMP throughout the construction stage of the Project. The EMP should be reviewed regularly and updated by the Contractor, preferably in a monthly basis.	To enhance water management practice and achieve waste reduction.	Contractor	All Work Sites	Construction Phase	ETWB TCW No. 19/2005

6.66	Storage, Collection and Transportation of Waste - Waste, such as soil, should be handled and stored well to ensure secure containment, thus minimizing the potential of pollution; - Maintain and clean storage areas routinely; - Stockpiling area should be provided with covers and water spraying system to prevent materials from wind-blown or being washed away; and - Different locations should be designated to stockpile each material to enhance reuse.	To minimize potential adverse environmental impacts arising from waste storage	Contractor	Work Sites	Construction Phase	
6.67	Storage, Collection and Transportation of Waste (con't) - Waste haulier with appropriate permits should be employed by the Contractor for the collection and transportation of waste from works areas to respective disposal outlets.	To minimize potential adverse environmental impacts arising from waste collection and disposal	Contractor	Waste storage area.	Construction Phase	-
6.68	Storage, Collection and Transportation of Waste (con't) - Implementation of trip ticket system with reference to ETWB TC(W) No.31/2004 to monitor disposal of waste and to control fly-tipping at PFRFs or landfills.	To minimize potential adverse environmental impacts arising from waste collection and disposal	Contractor	Work Sites	Construction Phase	ETWB TC(W) No.31/2004

	A recording system for the amount of waste generated, recycled and disposed (including disposal sites) should be proposed.					
6.70 – 6.73	Sorting of C&D Materials - Sorting to be performed to recover the inert materials, reusable and recyclable materials before disposal offsite Specific areas should be provided by the Contractors for sorting and to provide temporary storage areas for the sorted materials The C&D materials should at least be segregated into inert and non-inert materials, in which the inert portion could be reused and recycled as far as practicable before delivery to PFRFs as mentioned for beneficial use in other projects. While opportunities for reusing the non-inert portion should be investigated before disposal of at designated landfills Possibility of reusing the spoil in the Project will be continuously investigated in the construction stage.	To minimize potential adverse environmental impacts during the handling, transportation and disposal of C&D materials	Contractor	All work Sites	Construction Phase	ETWB TCW No. 31/2004 ETWB TCW No. 33/2002 ETWB TCW No. 19/2005
6.75	Sediments - The basic requirements and procedures for dredged	To ensure the sediment to be disposed of in an	Contractor	All works areas with sediments	Construction Phase	PNAP 252

	sediment disposal specified under PNAP 252 shall be followed. MFC manages disposal facilities in Hong Kong for the dredged sediment, while EPD is the authority issuing marine dumping permits under the <i>Dumping at Sea Ordinance</i> .	authorized and least impacted way		concern		
6.76	Sediments (con't) - The Project Proponent should agree in advance with MFC of CEDD on the site allocation by submitting a Construction & Demolition Material Management Plan. The contractor for the dredging works shall then apply for the site allocations of marine sediment disposal based on the prior agreement with MFC/CEDD. A request for reservation of sediment disposal space has been submitted to MFC for onward discussions of disposal approaches and feasible disposal sites. The Project Proponent is also responsible for application of all necessary permits from the relevant authorities, including the dumping permit as required under DASO from EPD, for the disposal of dredged sediment prior to the commencement of the dredging works.	To determine the best handling and disposal option of the sediments	MTR / Contractor	All works areas with sediments concern	Prior to the start of dredging works	PNAP 252; Dumping at Sea Ordinance

6.77 –	Sediments (con't)	To ensure	Contractor	Work Sites,	Construction	PNAP 252
6.81	- Requirements of the Air	handling of		Sediment	Phase	Dumping at
	Pollution Ordinance	sediments are in		disposal		Sea
	(Construction Dust) Regulation,	accordance to		sites		Ordinance
	where relevant, shall be	statutory				
	adhered to during dredging,	requirements				
	transportation and disposal of	'				
	sediments.					
	- Stockpiling of contaminated					
	sediments should be avoided					
	as far as possible. If temporary					
	stockpiling of contaminated					
	sediments is necessary, the					
	dredged sediment should be					
	covered by tarpaulin and the					
	area should be placed within					
	earth bunds or sand bags to					
	prevent leachate from entering					
	the ground, nearby drains					
	and/or surrounding water					
	bodies. The stockpiling areas					
	should be completely paved or					
	covered by linings in order to					
	avoid contamination to					
	underlying soil or groundwater.					
	Separate and clearly defined					
	areas should be provided for					
	stockpiling of contaminated and					
	uncontaminated materials.					
	Leachate, if any, should be					
	collected and discharged					
	according to the Water					
	Pollution Control Ordinance					
	(WPCO).					
	- In order to minimise the					
	potential odour / dust emissions					
	during dredging and					

		T		
	transportation of the sediment,			
	the dredged sediments should			
	be properly covered when			
	placed on barges. Loading of			
	the dredged sediment to the			
	barge should be controlled to			
	avoid splashing and			
	overflowing of the sediment			
	slurry to the surrounding water.			
	- The barge transporting the			
	sediments to the designated			
	disposal sites should be			
	equipped with tight fitting seals			
	to prevent leakage and should			
	not be filled to a level that			
	would cause overflow of			
	materials or laden water during			
	loading or transportation. In			
	addition, monitoring of the			
	barge loading shall be			
	conducted to ensure that loss			
	of material does not take place			
	during transportation. Transport			
	barges or vessels shall be			
	equipped with automatic self-			
	monitoring devices as specified			
	by the DEP.			
	- In order to minimise the			
	exposure to contaminated			
	materials, workers should wear			
	appropriate personal protective			
	equipments (PPE) when			
	handling contaminated			
	sediments. Adequate washing			
	and cleaning facilities should			
	also be provided on site.			
<u> </u>				

6.82	Sediments (con't) The dredging work and associate sediment handling under this Project will be undertaken together with the CWB project by Highways Department and geosynthetic containment will be adopted to handle Type 3 sediments.	To ensure handling of sediments are in accordance to statutory requirements	Contractor	Work Sites, Sediment disposal sites	Construction Phase	PNAP 252 Dumping at Sea Ordinance
6.86	Containers for Storage of Chemical Waste The Contractor should register with EPD as a chemical waste producer and to follow the guidelines stated in the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes. Containers used for storage of chemical waste should: - Be compatible with the chemical wastes being stored, maintained in good condition and securely sealed; - Have a capacity of less than 450 litters unless the specifications have been approved by EPD; and	To register with EPD as a Chemical waste producer and store chemical waste in appropriate containers	Contractor	Chemical waste storage area	Construction Phase	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes

	- Display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the Waste Disposal (Chemical Waste) (General) Regulation.					
6.87	Chemical Waste Storage Area - Be clearly labeled to indicate corresponding chemical characteristics of the chemical waste and used for storage of chemical waste only; - Be enclosed on at least 3 sides; - Have an impermeable floor and bunding, of capacity to accommodate 110% of the volume of the largest container or 20% by volume of the chemical waste stored in that area, whichever is the greatest; - Have adequate ventilation; - Be covered to prevent rainfall from entering; and - Be properly arranged so that incompatible materials are adequately separated.	To prepare appropriate storage areas for chemical waste at works areas	Contractor	Chemical waste storage area	Construction Phase	Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes
6.88	Labelling of Chemical Waste - Lubricants, waste oils and other chemical wastes would be generated during the maintenance of vehicles and mechanical equipments. Used	To clearly label the chemical waste at works areas	Contractor	Chemical waste storage area	Construction Phase	Code of Practice on the Packaging, Labelling and Storage of Chemical

	lubricants should be collected and stored in individual containers which are fully labeled in English and Chinese and stored in a designated secure place.					Wastes
6.89	Collection and Disposal of Chemical Waste - A trip-ticket system should be operated in accordance with the Waste Disposal (Chemical Waste) (General) Regulation to monitor all movements of chemical waste. The Contractor shall employ a licensed collector to transport and dispose of the chemical wastes, to either the approved CWTC at Tsing Yi, or another licensed facility, in accordance with the Waste Disposal (Chemical Waste) (General) Regulation.	To monitor the generation, reuse and disposal of chemical waste	Contractor	Work Sites with chemical waste production	Construction Phase	Waste Disposal (Chemical Waste) (General) Regulation
6.90	General Refuse - General refuse should be stored in enclosed bins or compaction units separate from C&D materials and chemical waste. A reputable waste collector should be employed by the contractor to remove general refuse from the site, separately from C&D materials and chemical wastes. Preferably, an enclosed and	To properly store and separate from other C&D materials for subsequent collection and disposal	Contractor	All Work Sites	Construction Phase	-

	covered area should be provided to reduce the occurrence of windblown light material.					
6.91	General Refuse (con't) - The recyclable component of general refuse, such as aluminum cans, paper and cleansed plastic containers should be separated from other waste. Provision and collection of recycling bins for different types of recyclable waste should be set up by the Contractor. The Contractor should also be responsible for arranging recycling companies to collect these materials.	To facilitate recycling of recyclable portions of refuse	Contractor	All Work Sites	Construction Phase	-
6.92	General Refuse (con't) - The Contractor should carry out an education programme for workers in avoiding, reducing, reusing and recycling of materials generation. Posters and leaflets advising on the use of the bins should also be provided in the sites as reminders.	To raise workers' awareness on recycling issue	Contractor	All Work Sites	Construction Phase	-

Appendix 4.1

Action and Limit Level

Action and Limit Level

Action and Limit Level for Air Quality Monitoring

1-hour TSP Level in μ g/m ³		24-hour TSP Level in μ g/m ³	
Action Level	Limit Level	Action Level	Limit Level
311.3	500	171.0	260

Action and Limit Level for Noise Monitoring

Time Period	Action Level	Limit Level
07:00 – 19:00 hours on normal weekdays	When one documented complaint is received.	75 dB(A)/ 70 dB(A)/ 65 db(A) ^{Note 1}

Note 1:

- 70dB(A) and 65 dB(A) for schools during normal teaching periods and school examination periods, respectively.
- If works are to be carried out during the restricted hours, the conditions stipulated in the Construction Noise Permit (CNP) issued by the Noise Control Authority have to be followed.

Action and Limit Level for Water Quality Monitoring

Parameters	Dry S	Dry Season		Wet Season		
	Action Level	Action Level Limit Level		Limit Level		
Cooling Water Inta	Cooling Water Intake					
SS in mg/L	15.00	22.13	18.42	27.54		
Turbidity in NTU	9.10	10.25	11.35	12.71		
DO in mg/L	3.36	2.73	3.02	2.44		

Remarks: - Contractor shall implement additional improvement measures in case of oxygen depletion (i.e. DO level <2 mg/L) detected within CBTS.

Appendix 4.2

Copies of Calibration Certificates



33624 Certificate No.

Page

4 Pages

Customer: Lam Geotechnics Limited

Address: 11/F, Centre Point, 181-185 Gloucester Road, Wanchai, Hong Kong.

Order No.: Q31494

Date of receipt

30-May-13

Item Tested

Description : Digital Sound Level Meter

Manufacturer: B&K

Model

: Type 2236

Serial No.

: 2100736

Test Conditions

Date of Test:

3-Jun-13

Supply Voltage : --

Ambient Temperature :

 $(23 \pm 3)^{\circ}C$

Relative Humidity: (50 ± 25) %

Test Specifications

Calibration check.

Ref. Document/Procedure: Z01.

Test Results

All results were within the IEC 651 Type 1, IEC 804 Type 1 & IEC 1260 Class 1 specification.

The results are shown in the attached page(s).

Main Test equipment used:

Equipment No. Description

Cert. No.

Traceable to

S017

Multi-Function Generator

C127181

SCL-HKSAR

S024

Sound Level Calibrator

30620

NIM-PRC & SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI).

The test results apply to the above Unit-Under-Test only

Calibrated by

Liam Wong

3-Jun-13

Date:

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



Certificate No. 33624

Page 2 of 4 Pages

Results:

1. SPL Accuracy

	J	JUT Setting			
Range	Parameter	Frequency Wt.	Freq. Response	Applied Value (dB)	UUT Reading (dB)
20 - 100	SPL	dBA	F	94.0	93.8
			S		93.8
		dBC	F		93.8
		dBL	F		93.9
		1 kHz	F		93.8
40 - 120	SPL	dBA	F	94.0	93.9
		1 kHz	F		93.9
	SPL	dBA	F	114.0	113.8
			S		113.8
		dBC	F		113.9
		dBL	F		113.9
		1 kHz	F		113.8

IEC 651 Type 1 Spec. : ± 0.7 dB

Uncertainty: ± 0.1 dB

2. Level Stability: 0.0 dB

IEC 651 Type 1 Spec. : \pm 0.3 dB

Uncertainty: ± 0.1 dB

3. Linearity

3.1 Level Linearity

UUT Range	Applied	UUT Reading	Variation	IEC 651 Type 1 Spec.
(dB)	Value (dB)	(dB)	(dB)	(Primary Indicator Range)
140	114.0	113.9	0.0	± 0.7 dB
130	104.0	103.9	0.0	
120	94.0	93.9 (Ref.)	Care Ann	
110	84.0	83.9	0.0	
100	74.0	73.9	0.0	
100	64.0	63.9	0.0	
100	54.0	53.9	0.0	

Uncertainty: $\pm 0.1 \text{ dB}$



Certificate No. 33624

Page 3 of 4 Pages

3.2 Differential level linearity

UUT Range	Applied	UUT Reading		
(dB)	Value (dB)	(dB)	Variation (dB)	IEC 651 Type 1 Spec.
120	84.0	83.9	0.0	± 0.4 dB
	94.0	93.9 (Ref.)	- :=:	
	95.0	94.9	0.0	± 0.2 dB

Uncertainty: ± 0.1 dB

4. Frequency Weighting

A weighting

Frequen	су	Attenuation (dl	B)	IEC 651 Type 1 Spec.
31.5 H	[z	-39.6		$-39.4 \text{ dB}, \pm 1.5 \text{ dB}$
63 H	[z	-26.4		- 26.2 dB, ± 1.5 dB
125 F	[z	-16.3		- 16.1 dB, ± 1 dB
250 H	[z	-8.8		- 8.6 dB, ± 1 dB
500 F	Iz	-3.3		- $3.2 dB, \pm 1 dB$
1 kF	Iz	0.0	(Ref)	$0 \text{ dB}, \pm 1 \text{ dB}$
2 kH	Iz	+1.2		+ 1.2 dB, ± 1 dB
4 kF	Iz	+0.9		+ 1.0 dB, ± 1 dB
8 kF	Iz	-1.2		- 1.1 dB, + 1.5 dB ~ -3 dB
16 kF	Iz	-6.8		- 6.6 dB, + 3 dB \sim - ∞

Uncertainty: ± 0.1 dB

5. Time Averaging

Applied Burst duty Factor	Applied Leq Value (dB)	UUT Reading (dB)	IEC 804 Type 1 Spec.
continuous	40.0	40.0	
1/10	40.0	39.9	± 0.5 dB
$1/10^2$	40.0	39.8	
$1/10^{3}$	40.0	39.7	± 1.0 dB
1/104	40.0	39.5	

Uncertainty: $\pm 0.1 \text{ dB}$



Certificate No. 33624

Page 4 of 4 Pages

6. Filter Response

Filter	Setting	Attenuation (dB)	IEC 1260 Class 1 Spec.
125	Hz	-63.6	<- 61
250	Hz	-44.8	< - 42
500	Hz	-21.0	< - 17.5
707	Hz	-3.7	- 2 ~ - 5
1	kHz (Ref.)	0.0 (Ref.)	
1.41	4 kHz	-4.1	- 2 ~ - 5
2	kHz	-21.4	< - 17.5
4	kHz	-45.0	< - 42
8	kHz	-63.9	<- 61

Uncertainty: ± 0.2 dB

Remark: 1. UUT: Unit-Under-Test

- 2. The uncertainty claimed is for a confidence probability of not less than 95%.
- 3. Atmospheric Pressure: 996 hPa
- 4. The UUT was adjusted with the laboratory's sound calibrator at the reference sound pressure level before the calibration.

----- END -----



Certificate No. 31707

1 of Page

2 Pages

Customer: Lam Geotechnics Limited

Address: 11/F, Centre Point, 181-185 Gloucester Road, Wanchai, Hong Kong.

Order No.: Q30699

Date of receipt

13-Mar-13

Item Tested

Description: Sound Level Calibrator

Manufacturer: Cesva

Model

: CB-5

Serial No.

: 0035092

Test Conditions

Date of Test: 20-Mar-13

Supply Voltage

Relative Humidity: (50 ± 25) %

Ambient Temperature: Test Specifications

Calibration check.

Calibration procedure:

F21, Z02.

 $(23 \pm 3)^{\circ}C$

Test Results

All results were within the IEC 942 Class1 specification.

The results are shown in the attached page(s).

Test equipment used:

Equipment No.	Description	Cert. No.	I raceable to
S014	Spectrum Analyzer	30259	NIM-PRC & SCL-HKSAR
S024	Sound Level Calibrator	30620	NIM-PRC & SCL-HKSAR

S041 **Universal Counter** 28347 SCL-HKSAR

The values given in this Calibration Certificate only relate to the values measured at the time of the test and any uncertainties quoted will not include allowance for the equipment long term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the measurement. Hong Kong Calibration Ltd. shall not be liable for any loss or damage resulting from the use of the equipment.

The test equipment used for calibration are traceable to International System of Units (SI). The test results apply to the above Unit-Under-Test only

Calibrated by:

Liam Wong

20-Mar-13

Date:

Dorothy Cheuk

This Certificate is issued by:

Hong Kong Calibration Ltd.

Unit 8B, 24/F., Well Fung Industrial Centre, No. 58-76, Ta Chuen Ping Street, Kwai Chung, NT, Hong Kong.

Tel: 2425 8801 Fax: 2425 8646

The copyright of this certificate is owned by Hong Kong Calibration Ltd.. It may not be reproduced except in full.



Certificate No. 31707

Page 2 of 2 Pages

Results:

1. Level Accuracy

UUT Nominal Value (dB)	Measured Value (dB)	IEC 942 Class 1 Spec.
94	93.94	± 0.3 dB

Uncertainty: ± 0.2 dB

2. Frequency

UUT Nominal Value	Measured Value	IEC 942 Class 1 Spec.
1 kHz	1.001 kHz	± 2 %

Uncertainty: $\pm 3.6 \times 10^{-6}$

3. Level Stability: 0.0 dB

IEC 942 Class 1 Spec. : ± 0.1 dB

Uncertainty: ± 0.01 dB

4. Total Harmonic Distortion : < 0.3 %

IEC 942 Class 1 Spec. : < 3 %Uncertainty : $\pm 2.3 \%$ of reading

Remark: 1. UUT: Unit-Under-Test

- 2. The above measured values are the mean of 3 measurements.
- 3. The uncertainty claimed is for a confidence probability of not less than 95%.
- 4. Atmospheric Pressure: 1003 hPa.

----- END -----

PILOT TESTING LIMTIED

Page 1 / 2

REPORT OF EQUIPMENT PERFORMANCE CHECK/ CALIBRATION

Information supplied by customer:

CONTACT: <u>DEREK LO</u>

WORK ORDER: HK1310015

CLIENT: LAM GEOTECHNICS LIMITED

DATE RECEIVED: <u>09/09/2013</u>
DATE OF ISSUE: <u>13/09/2013</u>

ADDRESS: 11/F, CENTRE POINT, 181-185, GLOUCESTER ROAD,

WANCHAI, HONG KONG

PROJECT: —

METHOD OF PERFORMANCE CHECK/ CALIBRATION:

Ref: APHA22nd ed 2130B

COMMENTS

It is certified that the item under performance check/calibration has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal acceptance criteria of Pilot Testing Limited will be followed.

Scope of Test:	Turbidity
Equipment Type:	Turbidimeter
Brand Name:	Xin Rui
Model No.:	WGZ-3B
Serial No.:	1203008
Equipment No.:	
Date of Calibration:	13 September, 2013

Remarks:

This is the Final Report. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr. Peter Lee

Director

This report may not be reproduced except with prior written approval from Pilot Testing Limited.

Address: Room 1503, 15/F, Wayson Commercial House, 68-70 Lockhart Road, Wanchai, Hong Kong Phone +852 2527 6691 | Email info@pilot-testing.com

WORK ORDER: HK1310015

DATE OF ISSUE: 13th September, 2013

CLIENT: LAM GEOTECHNICS LIMITED

Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203008	
Equipment No.:		
Date of Calibration:	13 September, 2013	
Date of next Calibration:	13 December, 2013	

Parameters:

Turbidity

Method Ref: APHA 22nd ed. 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.00	0
4	3.85	-3.8
10	10.2	+2.0
40	39.1	-2.2
100	95.0	-5.0
400	420	+5.0
1000	980	-2.0
	Tolerance Limit (±%)	10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration/checking regardless of equipment precision or significant figures.

Mr. Peter Lee

Director

This report may not be reproduced except with prior written approval from Pilot Testing Limited.

Information supplied by customer:

CONTACT: <u>DEREK LO</u> WORK ORDER: <u>HK1310017</u>

CLIENT: LAM GEOTECHNICS LIMITED

DATE RECEIVED: <u>09/09/2013</u> DATE OF ISSUE: <u>13/09/2013</u>

ADDRESS: 11/F, CENTRE POINT, 181-185, GLOUCESTER ROAD,

WANCHAI, HONG KONG

PROJECT: ---

METHOD OF PERFORMANCE CHECK/ CALIBRATION:

Ref: APHA22nd ed 2130B

COMMENTS

It is certified that the item under performance check/calibration has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal acceptance criteria of Pilot Testing Limited will be followed.

Scope of Test:	Turbidity	
Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203006	
Equipment No.:		
Date of Calibration:	13 September, 2013	

Remarks:

This is the Final Report. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr. Peter Lee

Director

This report may not be reproduced except with prior written approval from Pilot Testing Limited.

WORK ORDER: HK1310017

DATE OF ISSUE: 13th September, 2013

CLIENT: LAM GEOTECHNICS LIMITED

Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203006	
Equipment No.:		
Date of Calibration:	13 September, 2013	
Date of next Calibration:	13 December, 2013	

Parameters:

Turbidity

Method Ref: APHA 22nd ed. 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.00	0
4	3.85	-3.8
10	9.65	-3.5
40	42.0	+5.0
100	97.2	- 2.8
400	422	+5.5
1000	972	-2.8
	Tolerance Limit (±%)	10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration/checking regardless of equipment precision or significant figures.

Mr. Peter Lee

Director

This report may not be reproduced except with prior written approval from Pilot Testing Limited.

Information supplied by customer:

CONTACT: <u>DEREK LO</u> WORK ORDER: <u>HK1310007</u>

CLIENT: LAM GEOTECHNICS LIMITED

DATE RECEIVED: <u>30/07/2013</u> DATE OF ISSUE: <u>31/07/2013</u>

ADDRESS: 11/F, CENTRE POINT, 181-185, GLOUCESTER ROAD,

WANCHAI, HONG KONG

PROJECT: ---

METHOD OF PERFORMANCE CHECK/ CALIBRATION:

Ref: APHA22nd ed 2130B

COMMENTS

It is certified that the item under performance check/calibration has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal acceptance criteria of Pilot Testing Limited will be followed.

Scope of Test:	Turbidity	
Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203016	
Equipment No.:		
Date of Calibration:	31 July, 2013	

Remarks:

This is the Final Report. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr. Peter Lee

Director

WORK ORDER: <u>HK1310007</u>
DATE OF ISSUE: <u>31st July, 2013</u>

CLIENT: LAM GEOTECHNICS LIMITED

Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203016	
Equipment No.:		
Date of Calibration:	31 July, 2013	
Date of next Calibration:	30 October, 2013	

Parameters:

Turbidity

Method Ref: APHA 22nd ed. 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.02	+0.2
4	3.85	-3.8
10	9.68	-3.2
40	42.1	+5.2
100	96.0	-4.0
400	387	-3.2
1000	985	-1.5
	Tolerance Limit (±%)	10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration/checking regardless of equipment precision or significant figures.

Mr. Peter Lee

Director

This report may not be reproduced except with prior written approval from Pilot Testing Limited.

Information supplied by customer:

CONTACT: KATHIE HO WORK ORDER: HK1310025

CLIENT: LAM GEOTECHNICS LIMITED

DATE RECEIVED: <u>04/11/2013</u> DATE OF ISSUE: <u>05/11/2013</u>

ADDRESS: 11/F, CENTRE POINT, 181-185, GLOUCESTER ROAD,

WANCHAI, HONG KONG

PROJECT: ---

METHOD OF PERFORMANCE CHECK/ CALIBRATION:

Ref: APHA22nd ed 2130B

COMMENTS

It is certified that the item under performance check/calibration has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal acceptance criteria of Pilot Testing Limited will be followed.

Scope of Test:	Turbidity	
Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203016	
Equipment No.:		
Date of Calibration:	5 November, 2013	

Remarks:

This is the Final Report. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

Mr. Peter Lee

Director

WORK ORDER: <u>HK1310025</u>

DATE OF ISSUE: 5th November 2013

CLIENT: LAM GEOTECHNICS LIMITED

Equipment Type:	Turbidimeter	
Brand Name:	Xin Rui	
Model No.:	WGZ-3B	
Serial No.:	1203016	
Equipment No.:		
Date of Calibration:	5 November, 2013	
Date of next Calibration:	5 February, 2014	

Parameters:

Turbidity

Method Ref: APHA 22nd ed. 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.02	+0.2
4	4.27	+6.8
10	10.3	+3.0
40	42.4	+5.2
100	105	+5.0
400	417	+4.2
1000	970	-3.0
	Tolerance Limit (±%)	10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration/checking regardless of equipment precision or significant figures.

Mr. Peter Leé

Director



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:

MR DEREK LO

CLIENT:

LAM GEOTECHNICS LIMITED

ADDRESS:

11/F., CENTRE POINT,

181-185 GLOUCESTER ROAD,

WAN CHAI, HONG KONG

PROJECT:

WORK ORDER:

HK1327829

LABORATORY:

HONG KONG

DATE RECEIVED:

09/10/2013

DATE OF ISSUE:

17/10/2013

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:

Dissolved Oxygen, pH, Salinity and Temperature

Equipment Type:

Multimeter

Brand Name: Model No.:

YSI

Professional plus

Serial No.:

11F100597

Equipment No.:

Date of Calibration: 15 October, 2013

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Ptv Ltd

11/F Chung Shun Knitting Centre

1-3 Wing Yip Street

Kwai Chung HONG KONG Phone:

852-2610 1044

Fax:

852-2610 2021

Email:

hongkong@alsglobal.com

Mr. Fung Lim Chee General Manager

Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

Work Order: Date of Issue: HK1327829 17/10/2013

Client:

LAM GEOTECHNICS LIMITED



Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus 11F100597

Serial No.:

--

Equipment No.: Date of Calibration:

15 October, 2013

Date of next Calibration:

15 January, 2014

Parameters:

Dissolved Oxygen

Method Ref: APHA (21st edition), 45000: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
	1.00	0.04
1.85	1.89	0.04
5.22	5.37	0.15
7.95	7.96	0.01
	Tolerance Limit (±mg/L)	0.20

pH Value

Method Ref: APHA (21st edition), 4500H:B

Method Ren 74 Th (21st edition), 1soonis		
Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)
4.0	4.01	0.01
7.0	6.98	-0.02
10.0	10.02	0.02
	Tolerance Limit (±pH unit)	0.20

Salinity

Method Ref: APHA (21st edition), 2520B

Method Ref. Al IIA (21st cultion), 25205		
Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.02	
10	9.61	-3.9
20	19.65	-1.8
30	29.86	-0.5
	Tolerance Limit (± ppt)	10.0

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
11.0	11.5	0.5
25.0	23.8	-1.2
38.0	37.1	-0.9
	Tolerance Limit (±°C)	2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard

General Manager -

Greater China & Hong Kong

ALS Technichem (HK) Pty Ltd

ALS Environmental



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:

MR DEREK LO

CLIENT:

LAM GEOTECHNICS LIMITED

ADDRESS:

11/F., CENTRE POINT,

181-185 GLOUCESTER ROAD,

WAN CHAI, HONG KONG

PROJECT:

1185

WORK ORDER:

HK1326638

LABORATORY:

HONG KONG

DATE RECEIVED:

27/09/2013

DATE OF ISSUE:

07/10/2013

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:

Dissolved Oxygen, pH, Salinity and Temperature

Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

11F100420

Equipment No.:

...

Date of Calibration: 07 October, 2013

NOTES

This is the Final Report and supersedes any preliminary report with this batch number.

Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre

1-3 Wing Yip Street

Kwai Chung HONG KONG Phone:

852-2610 1044

Fax:

852-2610 2021

Email:

hongkong@alsglobal.com

Mr. Fung Lim Chee, Richard General Manager -Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

Work Order: Date of Issue: HK1326638

Client:

07/10/2013 LAM GEOTECHNICS LIMITED



Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

11F100420

Equipment No.: Date of Calibration:

07 October, 2013

Date of next Calibration:

07 January, 2014

Parameters:

Dissolved Oxygen

Method Ref: APHA (21st edition), 45000: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
		0.01
2.32	2.33	0.01
4.36	4.32	-0.04
6.30	6.29	-0.01
	Tolerance Limit (±mg/L)	0.20

pH Value

Method Ref: APHA (21st edition), 4500H:B

	,,	
Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)
4.0	4.17	0.17
7.0	7.19	0.19
10.0	9.96	-0.04
	Tolerance Limit (±pH unit)	0.20

Salinity

Method Ref: APHA (21st edition), 2520B

Method Relivit IV (225t edition), 25255		
Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.03	
10	9.94	-0.6
20	19.49	-2.6
30	29.55	-1.5
	Tolerance Limit (±%)	10.0

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
10.0 24.0 41.0	9.8 23.1 40.4	-0.2 -0.9 -0.6
	Tolerance Limit (±°C)	2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard

General Manager

Greater China & Hong Kong



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:

MR DEREK LO

CLIENT:

LAM GEOTECHNICS LIMITED

ADDRESS:

11/F., CENTRE POINT,

181-185 GLOUCESTER ROAD,

WAN CHAI, HONG KONG

PROJECT:

WORK ORDER:

HK1323779

LABORATORY:

HONG KONG

DATE RECEIVED:

02/09/2013

DATE OF ISSUE:

17/09/2013

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:

Dissolved Oxygen, pH, Salinity and Temperature

Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

13A100242

Equipment No.:

Date of Calibration: 07 September, 2013

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre

1-3 Wing Yip Street

Kwai Chung HONG KONG Phone:

852-2610 1044

Fax:

852-2610 2021

Email:

hongkong@alsglobal.com

Mr. Fung Lim Chee, Richard

General Manager -

Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 3

ADDRESS 11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, N.T., Hong Kong | PHONE +852 2610 1044 | FAX +852 2610 2021 ALS TECHNICHEM (HK) PTY LTD An ALS Limited Company

Work Order: Date of Issue: HK1323779 17/09/2013

Client:

LAM GEOTECHNICS LIMITED



Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

13A100242

Equipment No.:

Date of Calibration:

07 September, 2013

Date of next Calibration:

07 December, 2013

Parameters:

pH Value

Method Ref: APHA (21st edition), 4500H:B

Expected Reading (pH Unit)	Displayed Reading (pH Unit)	Tolerance (pH unit)
4.0	4.04	0.04
7.0	7.14	0.14
10.0	10.14	0.14
	Tolerance Limit (±pH unit)	0.20

Salinity

Method Ref: APHA (21st edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.00	
10	10.22	2.2
20	20.80	4.0
30	30.55	1.8
	Tolerance Limit (±%)	10.0

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical

Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
9.5	10.1	0.6
24.0	23.0	-1.0
38.0	37.1	-0.9
	Tolerance Limit (±°C)	2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless

of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard General Manager -Greater China & Hong Kong

ALS Technichem (HK) Pty Ltd

Page 2 of 3

Work Order:

HK1323779

Date of Issue:

17/09/2013

Client:

LAM GEOTECHNICS LIMITED



Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

13A100242

Equipment No.:

--

Date of Calibration:

07 September, 2013

Date of next Calibration:

07 December, 2013

Parameters:

Dissolved Oxygen

Method Ref: APHA (21st edition), 45000: G

1st time

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
5.26 6.20 8.28	4.54 5.90 8.01	-0.72 -0.30 -0.27
	Tolerance Limit (±mg/L)	0.20

Method Ref: APHA (21st edition), 45000: G

2nd time

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
4.45 6.62 8.31	3.43 6.39 8.45	-1.02 -0.23 0.14
	Tolerance Limit (±mg/L)	0.20

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

PP

Mr. Fung Lim Chee, Richard General Manager -

Greater China & Hong Kong



ALS Technichem (HK) Pty Ltd

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:

MR DEREK LO

CLIENT:

LAM GEOTECHNICS LIMITED

ADDRESS:

11/F., CENTRE POINT,

181-185 GLOUCESTER ROAD,

WAN CHAI, HONG KONG

PROJECT:

WORK ORDER:

HK1327060

LABORATORY:

HONG KONG

DATE RECEIVED:

03/10/2013

DATE OF ISSUE:

08/10/2013

COMMENTS

It is certified that the item under calibration/checking has been calibrated/checked by corresponding calibrated equipment in the laboratory.

Maximum Tolerance and calibration frequency stated in the report, unless otherwise stated, the internal aceptance criteria of ALS will be followed.

Scope of Test:

Dissolved Oxygen

Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

13A100242

Equipment No.:

Date of Calibration: 08 October, 2013

NOTES

This is the Final Report and supersedes any preliminary report with this batch number. Results apply to sample(s) as submitted. All pages of this report have been checked and approved for release.

ISSUING LABORATORY: HONG KONG

Address

ALS Technichem (HK) Pty Ltd

11/F Chung Shun Knitting Centre

1-3 Wing Yip Street

Kwai Chung HONG KONG Phone:

852-2610 1044

Fax:

852-2610 2021

Email:

hongkong@alsglobal.com

Mr. Fung Lim Chee, Richard General Manager:

Greater China & Hong Kong

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

Page 1 of 2

Work Order: Date of Issue:

HK1327060 08/10/2013

Client:

LAM GEOTECHNICS LIMITED



Equipment Type:

Multimeter

Brand Name:

YSI

Model No.:

Professional plus

Serial No.:

13A100242

Equipment No.:

--

Date of Calibration:

08 October, 2013

Date of next Calibration:

08 January, 2014

Parameters:

Dissolved Oxygen

Method Ref: APHA (21st edition), 45000: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
	_ 5	
7.85	7.68	-0.17
5.82	5.67	-0.15
3.24	3.18	-0.06
	Tolerance Limit (±mg/L)	0.20

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr. Fung Lim Chee, Richard

General Manager

Greater China & Hong Kong



TISCH ENVIROMENTAL, INC. 145 SOUTH MIAMI AVE. VILLAGE OF CLEVES, OH 45002 513.467.9000 877.263.7610 TOLL FREE 513.467.9009 FAX WWW.TISCH-ENV.COM

AIR POLLUTION MONITORING EQUIPMENT

ORIFICE TRANSFER STANDARD CERTIFICATION WORKSHEET TE-5025A

Date - Ju Operator		Rootsmeter Orifice I.I	,	438320 0005	Ta (K) - Pa (mm) -	759.46
					METER	ORFICE
PLATE	VOLUME	VOLUME	DIFF	DIFF	DIFF	DIFF
OR	START	STOP	VOLUME	TIME	Hg	H2O
Run #	(m3)	(m3)	(m3)	(min)	(mm)	(in.)
1	NA	NA	1.00	1.3910	.3.2	2.00
2	NA	NA	1.00	0.9830	6.4	4.00
3	NA	NA	1.00	0.8800	7.9	5.00
4	NA	NA	1.00	0.8380	8.8	5.50
5	NA	NA	1.00	0.6930	12.7	8.00

DATA TABULATION

Vstd	(x axis) Qstd	(y axis)		Va	(x axis) Qa	(y axis)
0.9884 0.9843 0.9822 0.9811 0.9760	0.7106 1.0013 1.1161 1.1708 1.4084	1.4090 1.9926 2.2278 2.3365 2.8180		0.9958 0.9916 0.9895 0.9884 0.9832	0.7159 1.0087 1.1244 1.1795 1.4188	0.8888 1.2570 1.4054 1.4740 1.7777
Qstd slop intercept coefficie	(b) = ent (r) =	2.01968 -0.02746 0.99999		Qa slope intercept coefficie	t (b) = ent (r) =	1.26469 -0.01732 0.99999
y axis =	SQRT[H2O(F	Pa/760)(298/	ľa)]	y axis =	SQRT[H2O(7	[a/Pa)]

CALCULATIONS

Vstd = Diff. Vol[(Pa-Diff. Hg)/760](298/Ta)
Qstd = Vstd/Time

Va = Diff Vol [(Pa-Diff Hg)/Pa]

Qa = Va/Time

For subsequent flow rate calculations:

Qstd = $1/m\{ [SQRT (H2O (Pa/760) (298/Ta))] - b \}$ Qa = $1/m\{ [SQRT H2O (Ta/Pa)] - b \}$



Location

: CMA3a

Calibration Data for High Volume Sampler (TSP Sampler)

Calbration Date

18-Oct-13

Equipment no.		EL333			Calbratio	n Due Dat	: 18-Dec-13	
CALIBRATION OF CON	ITINUOUS	FLOW RE	CORDER					
			A	mbient Condition				
Temperature, T _a		302		Kelvin Pressure, P	a	1	1010 mmF	łg
			Orifice Tra	nsfer Standard Inform	ation			
Equipment No.		EL086		Slope, m _c 2.019	968 In	tercept, bc	-0.02746	
Last Calibration Date		15-Jul-1	3	(Hx	P _a / 1013.	.3 x 298 /	$(T_a)^{1/2}$	
Next Calibration Date		15-Jul-1	4	=	$m_c \times Q$	$b_{std} + b_c$		
			C	Calibration of RSP				
Calibration	Mar	nometer R	eading	Q _{std}	Continuo	us Flow	IC	
Point	Н (inches of	water)	(m ³ / min.)	Record	er, W	W(P _a /1013.3x298/T _a) ^{1/2} /	35.31)
	(up)	(down)	(difference)	X-axis	(CFI	M)	Y-axis	
1	6.0	6.0	12.0	1.7146	60		59.5042	
2	4.9	4.9	9.8	1.5508	51		50.5786	
3	4.0	4.0	8.0	1.4025	42		41.6529	
4	2.5	2.5	5.0	1.1116	26		25.7852	
5	1.6	1.6	3.2	0.8920	15		14.8760	
By Linear Regression of	Y on X							
	Slope, m	=	54.5	984 In	tercept, b =	-34	1.3703	
Correlation C	oefficient*	=	0.99					
Calibration	Accepted	=	Yes/ I	\0 **				
* if Correlation Coefficien	nt < 0.990,	check and	recalibration	again.				
** Delete as appropriate.								
Remarks :								
Calibrated by		Henry			Checked	by	Derek Lo	
Date	1	8-Oct-13			Date		: 18-Oct-13	

Appendix 5.1

Monitoring Schedules for Reporting Month and Coming Reporting Month

Wan Chai Development Phase II and Central-Wan Chai Bypass Sampling, Field Measurement and Testing Works (Stage 2)

Environmental Monitoring Schedule November 2013

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
-	28-Oct	29-Oct	30-Oct	31-Oct	01-Nov	02-Nov
	24hr TSP					24hr TSP
	24nr 15P	1hr TSP				24Nr 15P
	Noise (Daytime)	1111 101				
	, , ,					
	Impact WQM		Impact WQM		Impact WQM	
	Mid-ebb 6:48		Mid-ebb 8:55		Mid-ebb 10:37	
	Mid-flood 14:49		Mid-flood 15:47		Mid-flood 16:38	
03-Nov	04-Nov	05-Nov	06-Nov	07-Nov	08-Nov	09-Nov
					24hr TSP	
	1hr TSP					1hr TSP
		Noise (Daytime)				
	Impact WQM		Impact WQM		Impact WQM	
	Mid-ebb 12:45 Mid-flood 18:20		Mid-flood 8:35 Mid-ebb 14:14		Mid-ebb 3:13 Mid-flood 10:32	
10-Nov	11-Nov	12-Nov	13-Nov	14-Nov	15-Nov	16-Nov
				24hr TSP		
		Mala (Dauthur)			1hr TSP	
		Noise (Daytime)				
	Impact WQM		Impact WQM		Impact WQM	
	Mid-ebb 6:37		Mid-ebb 8:53		Mid-ebb 10:38	
	Mid-flood 13:52		Mid-flood 15:28		Mid-flood 16:41	
17-Nov	18-Nov	19-Nov	20-Nov	21-Nov	22-Nov	23-Nov
			24hr TSP			
			2411 101	1hr TSP		
			Noise (Daytime)			
		Impact WQM		Impact WQM		Impact WQM
		Mid-ebb 0:57		Mid-ebb 2:01		Mid-ebb 2:40
24.11	05 N	Mid-flood 7:45	07.1	Mid-flood 9:04		Mid-flood 10:43
24-Nov	25-Nov	26-Nov	27-Nov			
		24hr TSP				
			1hr TSP			
		Noise (Daytime)				
	h					
	Impact WQM	Impact WQM				
	Mid-flood 12:38	Mid-ebb 4:58				
	12.30	4.56		l	I	

Wan Chai Development Phase II and Central-Wan Chai Bypass Sampling, Field Measurement and Testing Works (Stage 2)

Tentative Environmental Monitoring Schedule December 2013

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				28-Nov	29-Nov	30-Nov
				Impact WQM		Impact WQM
				Mid-ebb 8:01		Mid-ebb 10:04
				Mid-flood 14:38		Mid-flood 15:50
01-Dec	02-Dec	03-Dec	04-Dec	05-Dec	06-Dec	07-Dec
	24hr TSP					24hr TSP
		1hr TSP				
	Noise (Daytime)		Noise (Daytime)			
	Impact WQM Mid-flood 17:08		Impact WQM Mid-ebb 13:17			Impact WQM Mid-ebb 3:03
	Mid-ebb 23:52		Mid-flood 18:35			Mid-flood 10:17
08-Dec	09-Dec	10-Dec	11-Dec	12-Dec	13-Dec	14-Dec
17 - 11	***					
					24hr TSP	
	1hr TSP					1hr TSP
		Noise (Daytime)	Noise (Daytime)			
	Impact WQM		Impact WQM		Impact WQM	
	Mid-ebb 4:48		Mid-flood 13:54		Mid-flood 15:24	
	Mid-flood 12:06		Mid-ebb 20:34		Mid-ebb 22:20	
15-Dec	16-Dec	17-Dec	18-Dec	19-Dec	20-Dec	21-Dec
				24hr TSP		
	Noise (Daytime)	Noise (Daytime)			1hr TSP	
	,	,				
	Impact WQM	Impact WQM	Impact WQM	Impact WQM		Impact WQM
						Mid-ebb 2:04
			Mid-flood 18:08	Mid-ebb 1:14		Mid-flood 9:19
22-Dec	23-Dec	24-Dec	25-Dec	26-Dec	27-Dec	
	24hr TSP					
		1hr TSP				
	Noise (Daytime)	Noise (Daytime)				
		Impact WQM		Impact WQM		
		Mid-ebb 3:29		Mid-ebb 4:54		
		Mid-flood 11:22		Mid-flood 12:50		
		11.22		12.00		

Appendix 5.2

Noise Monitoring Results and Graphical Presentations



Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

Location: M2b - Noon-day gun area

			Measure	ement Noi	se Level	Baseline Level	Construction Noise Level	Limit Level
Date	Time	Weather	Leq	L10	L90	Leq	Leq	Leq
						Unit: dB(A), (3	30-min)	
28/10/2013	17:10	Fine	72.2	74.5	69.0	68	70	75
05/11/2013	10:50	Cloudy	70.4	72.0	68.0	68	67	75
12/11/2013	10:12	Cloudy	69.7	71.0	67.5	68	66	75
20/11/2013	9:30	Cloudy	69.5	71.0	67.0	68	65	75
26/11/2013	8:15	Fine	69.0	70.5	67.0	68	63	75




Wanchai Development Phase II and Central Wanchai Bypass

(Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Graphic Presentation of Noise Monitoring Result

Day Time (0700 - 1900hrs on normal weekdays)

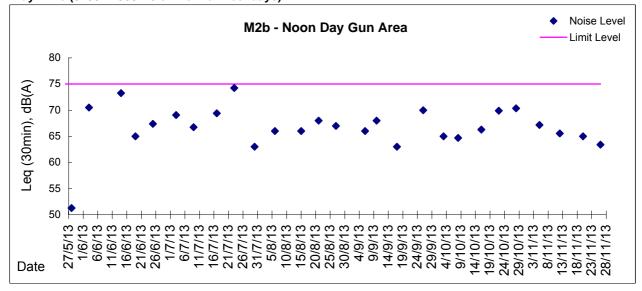

Appendix 5.3 Air Quality Monitoring Results and Graphical Presentations



Location: CMA3a - CWB PRE Site Office Area


Report on 24-hour TSP monitoring Action Level (µg/m3) - 171 Limit Level (µg/m3) - 260


Date	Sampling	Weather	Filter paper	Filter Weigh	nt, g	Elapse Time	e, hr	Sampling	Flo	w Rate, m ³ /i	Total	TSP Level,	
	Time	Condition	no.	Initial	Final	Initial	Final	Time, hr	Initial, Qsi	Final, Q _{sf}	Average	Volume, m ³	μg/m ³
28-Oct-13	8:00	Fine	005902	2.6358	2.8926	736.89	760.89	24.00	1.39	1.39	1.39	2001	128
02-Nov-13	8:00	Fine	007624	2.6453	2.8519	763.89	787.89	24.00	1.37	1.37	1.37	1968	105
08-Nov-13	8:00	Cloudy	005818	2.6562	2.9037	790.89	814.89	24.00	1.38	1.38	1.38	1993	124
14-Nov-13	8:00	Cloudy	006290	2.6404	2.7837	817.89	841.90	24.01	1.37	1.37	1.37	1974	73
20-Nov-13	8:00	Cloudy	005795	2.8507	3.1646	844.90	868.90	24.00	1.34	1.34	1.34	1930	163
26-Nov-13	8:00	Cloudy	005490	2.8048	3.1049	871.90	895.90	24.00	1.34	1.34	1.34	1930	156

Report on 1-hour TSP monitoring Action Level (μ g/m3) - 311.3 Limit Level (μ g/m3) - 500


Date	Sampling	Weather	Filter paper	Filter Weigh	nt, g	Elapse Tim	e, hr	Sampling	Flo	w Rate, m ³ /	min	Total	TSP Level,
	Time	Condition	no.	Initial	Final	Initial	Final	Time, hr	Initial, Q _{si}	Final, Q _{sf}	Average	Volume, m ³	μg/m ³
29-Oct-13	10:30	Fine	004874	2.7429	2.7613	760.89	761.89	1.00	1.37	1.37	1.37	82	224
29-Oct-13	13:00	Fine	006678	2.6563	2.6701	761.89	762.89	1.00	1.39	1.39	1.39	83	166
29-Oct-13	14:30	Fine	005495	2.8236	2.8395	762.89	763.89	1.00	1.41	1.41	1.41	84	188
04-Nov-13	14:20	Rainy	005823	2.6441	2.6653	787.89	788.89	1.00	1.37	1.37	1.37	82	257
04-Nov-13	15:40	Rainy	005821	2.6415	2.6587	788.89	789.89	1.00	1.37	1.37	1.37	82	209
04-Nov-13	16:50	Rainy	005822	2.6544	2.6724	789.89	790.89	1.00	1.37	1.37	1.37	82	219
09-Nov-13	8:15	Cloudy	006294	2.6008	2.6109	814.89	815.89	1.00	1.37	1.37	1.37	82	123
09-Nov-13	9:20	Cloudy	006297	2.6256	2.6410	815.89	816.89	1.00	1.37	1.37	1.37	82	188
09-Nov-13	10:25	Cloudy	006295	2.6314	2.6459	816.89	817.89	1.00	1.37	1.37	1.37	82	177
15-Nov-13	8:05	Fine	005848	2.6272	2.6386	841.90	842.90	1.00	1.37	1.37	1.37	82	139
15-Nov-13	9:10	Fine	005855	2.6129	2.6252	842.90	843.90	1.00	1.37	1.37	1.37	82	150
15-Nov-13	10:15	Fine	005858	2.6438	2.6579	843.90	844.90	1.00	1.37	1.37	1.37	82	172
21-Nov-13	10:50	Cloudy	005929	2.6270	2.6479	868.90	869.90	1.00	1.38	1.38	1.38	83	253
21-Nov-13	13:00	Cloudy	005931	2.6424	2.6601	869.90	870.90	1.00	1.38	1.38	1.38	83	215
21-Nov-13	14:15	Cloudy	005489	2.8088	2.8246	870.90	871.90	1.00	1.34	1.34	1.34	80	197
27-Nov-13	10:40	Cloudy	006237	2.6500	2.6630	895.90	896.90	1.00	1.38	1.38	1.38	83	157
27-Nov-13	14:04	Cloudy	005989	2.6368	2.6620	896.90	897.90	1.00	1.38	1.38	1.38	83	305
27-Nov-13	15:08	Cloudy	005986	2.6247	2.6466	897.90	898.90	1.00	1.34	1.34	1.34	80	272



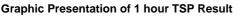

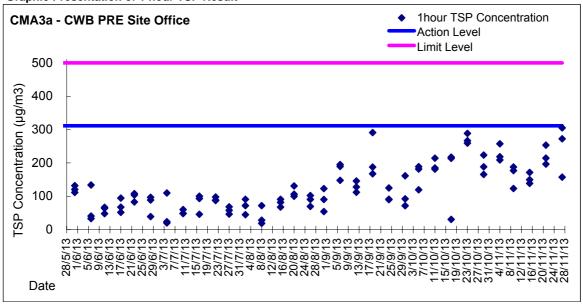

Graphic Presentation of 24 hour TSP Result

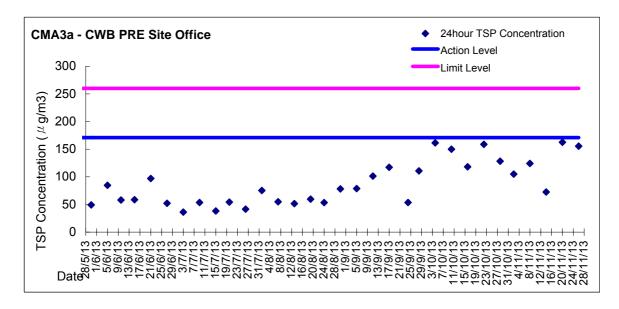

Appendix 5.4 Water Quality Monitoring Results and Graphical Presentation



Water Monitoring Result at C7 - Windsor House Mid-Flood Tide

Date	Time	Weater Condition	Samplin	g Depth	Wat	er Temp	erature		рН			Salini ppt	ty	D	O Satur	ation		DO mg/L			Turbid NTU	ity	Suspend	
		Condition	n	n	Va	lue	Average	Va	lue -	Average	Va	lue	Average	Va	alue	Average	Va		Average	Va	lue	Average	Value	Average
28/10/13	15:10	Fine	Middle	1.5	25.89	25.89	25.99	7.27	7.27	7.27	32.68	32.68	32.71	51.0	51.2	51.4	3.44	3.46	3.47	4.84	4.84	4.83	4	4.00
26/10/13	15:12	FILLE	Middle	1.5	26.09	26.09	25.99	7.27	7.27	1.21	32.74	32.74	32.71	51.6	51.8	51.4	3.48	3.50	5.47	4.81	4.82	4.03	4	4.00
30/10/13	15:30	Fine	Middle	1.5	26.22	26.22	26.27	7.17	7.17	7.17	32.66	32.66	32.68	53.3	53.5	53.9	3.58	3.59	3.62	3.97	3.98	3.99	6	5.00
30/10/13	15:32	Tille	Middle	1.5	26.31	26.31	20.27	7.17	7.17	7.17	32.69	32.69	32.00	54.2	54.4	30.9	3.64	3.65	3.02	4.01	4.01	3.33	4	3.00
01/11/13	16:09	Fine	Middle	1.5	26.07	26.07	26.07	7.05	7.05	7.05	31.98	31.98	32.02	61.6	61.5	61.5	4.16	4.16	4.16	4.94	4.87	4.85	5	4.50
01/11/13	16:11	Tillo	Middle	1.5	26.07	26.07	20.07	7.04	7.04	7.00	32.05	32.05	32.02	61.5	61.4	01.5	4.15	4.15	4.10	4.77	4.83	4.03	4	4.50
04/11/13	19:08	Cloudy	Middle	1.5	23.90	23.90	23.90	8.20	8.20	8.19	29.10	29.10	28.59	56.5	56.5	56.7	4.04	4.04	4.05	6.61	6.43	6.46	6	5.50
04/11/13	19:09	Oloudy	Middle	1.5	23.90	23.90	20.00	8.17	8.17	0.13	28.07	28.07	20.55	56.8	56.8	30.7	4.06	4.06	4.00	6.39	6.42	0.40	5	3.30
06/11/13	11:25	Fine	Middle	1.5	25.18	25.18	25.18	7.44	7.44	7.44	32.72	32.72	32.72	52.1	52.3	52.4	3.58	3.58	3.59	2.87	2.89	2.89	3	3.00
	11:27		Middle	1.5	25.18	25.18		7.43	7.43		32.72	32.72		52.4	52.8		3.59	3.60		2.90	2.90		3	
08/11/13	12:25	Fine	Middle	1.5	25.90	25.90	25.93	7.24	7.24	7.24	32.84	32.84	32.86	53.4	53.5	53.6	3.61	3.61	3.62	4.31	4.35	4.34	3	3.00
	12:27		Middle	1.5	25.96	25.96		7.23	7.23		32.87	32.87		53.6	53.8		3.62	3.63		4.35	4.36		3	
11/11/13	15:02	Cloudy	Middle	1.5	24.78	24.78	24.78	7.52	7.52	7.52	32.95	32.95	32.95	49.3	49.4	49.5	3.39	3.40	3.41	3.71	3.69	3.68	5	6.00
	15:04	,	Middle	1.5	24.78	24.78		7.51	7.51		32.95	32.95		49.5	49.8		3.41	3.42		3.67	3.66		7	<u> </u>
13/11/13	14:56	Cloudy	Middle	1.5	23.74	23.74	23.72	7.70	7.70	7.70	32.71	32.71	32.72	49.9	50.1	50.2	3.50	3.51	3.52	1.52	1.51	1.52	4	4.00
	14:57		Middle	1.5	23.69	23.69		7.69	7.69		32.73	32.73		50.3	50.4		3.53	3.53		1.52	1.53		4	
15/11/13	15:50	Fine	Middle	1.5	24.36	24.36	24.36	7.52	7.52	7.52	32.92	32.92	32.92	54.7	54.9	54.9	3.79	3.80	3.80	3.10	3.11	3.11	4	5.00
	15:52		Middle	1.5	24.36	24.36		7.52	7.52		32.91	32.91		54.9	55.0		3.81	3.81		3.12	3.12		6	
19/11/13	10:05	Fine	Middle	1.5	22.77	22.77	22.77	7.55	7.55	7.56	33.35	33.35	33.36	47.8	47.9	48.0	3.40	3.40	3.41	2.92	2.93	2.94	6	5.50
	10:07		Middle	1.5	22.77	22.77		7.56	7.56		33.36	33.36	1	48.0	48.1		3.41	3.42		2.94	2.96		5	<u> </u>
21/11/13	11:07	Fine	Middle	1.5	22.53	22.53	22.53	7.49	7.49	7.49	33.11	33.11	33.11	60.7	60.5	63.5	4.37	4.33	4.33	2.61	2.64	2.63	2	2.00
	11:09		Middle	1.5	22.53	22.53		7.49	7.49		33.10	33.10	1	66.4	66.3		4.31	4.31		2.65	2.63		2	<u> </u>
23/11/13	11:47	Fine	Middle	1.5	22.77	22.77	22.78	7.56	7.56	7.56	33.63	33.63	33.64	53.7	53.7	53.6	3.81	3.81	3.81	3.49	3.57	3.40	2	2.00
	11:49		Middle	1.5	22.79	22.79		7.56	7.56		33.65	33.65		53.4	53.5		3.79	3.81		3.33	3.21		2	
25/11/13	12:52	Fine	Middle	1.5	22.68	22.68	22.69	7.32	7.32	7.32	32.87	32.87	32.87	47.6	46.6	47.0	3.40	3.32	<u>3.35</u>	1.49	1.44	1.45	5	4.50
	12:54		Middle	1.5	22.70	22.70		7.32	7.32		32.87	32.87		47.0	46.8		3.35	3.34		1.44	1.44		4	


Remarks: Single underline denotes exceedance over Action Level. Double underline denotes exceedance over Limit Level.





Water Monitoring Result at C7 - Windsor House Mid-Ebb Tide

Date	Time	Weater Condition	Samplin	•	Wat	er Temp °C	erature		pН			Salini	ty	D	O Satur	ation		DO mg/L			Turbid NTU		Suspend	led Solids
		Condition	n	n	Va	llue	Average	Va	lue	Average	Va	ılue	Average	Va	ılue	Average	Va		Average	Va	lue	Average	Value	Average
28/10/13	4:18	Fine	Middle	2	23.60	23.60	23.55	8.16	8.16	8.15	30.78	30.80	30.80	58.9	60.8	60.4	4.19	4.33	4.30	2.78	2.65	2.66	<2	- <2
20/10/13	4:19	rine	Middle	2	23.50	23.50	23.33	8.14	8.14	0.15	30.80	30.80	30.60	61.0	60.9	60.4	4.33	4.34	4.50	2.61	2.58	2.00	<2	<2
30/10/13	11:32	Fine	Middle	2	25.65	25.65	25.65	7.30	7.30	7.30	32.16	32.16	32.16	57.6	57.8	58.0	3.92	3.93	3.95	4.60	4.65	4.65	4	3.50
30/10/13	11:34	Tille	Middle	2	25.65	25.65	25.05	7.30	7.30	7.50	32.16	32.16	32.10	58.3	58.4	36.0	3.96	3.98	5.85	4.68	4.68	4.03	3	3.30
01/11/13	12:17	Fine	Middle	2	25.49	25.49	25.50	7.21	7.21	7.22	31.78	31.78	31.76	49.8	39.6	47.7	3.37	3.36	3.46	3.65	3.67	3.66	<2	<2
01/11/13	12:19	Tille	Middle	2	25.51	25.51	25.50	7.22	7.22	7.22	31.74	31.74	31.70	49.8	51.7	47.7	3.37	3.73	3.40	3.66	3.65	3.00	<2	
04/11/13	15:04	Cloudy	Middle	2	24.75	24.75	24.76	7.46	7.46	7.45	31.81	31.81	31.81	62.6	62.6	62.6	4.34	4.33	4.33	3.48	3.52	3.52	2	2.00
04/11/13	15:06	Oloudy	Middle	2	24.76	24.76	24.70	7.44	7.44	7.40	31.81	31.81	31.01	62.5	62.5	02.0	4.33	4.32	4.00	3.54	3.55	0.02	2	2.00
06/11/13	14:12	Fine	Middle	2	25.52	25.52	25.54	7.31	7.31	7.31	32.41	32.41	32.41	64.5	64.4	64.4	4.40	4.39	4.39	2.50	2.58	2.55	2	2.00
00/11/13	14:14	Tille	Middle	2	25.56	25.56	20.04	7.31	7.31	7.01	32.41	32.41	32.41	64.3	64.2	04.4	4.38	4.37	4.00	2.52	2.59	2.00	2	2.00
08/11/13	2:47	Fine	Middle	1	23.80	23.80	23.80	8.10	8.10	8.10	30.80	30.80	30.80	56.3	57.2	56.8	3.99	4.05	4.02	2.82	2.84	2.79	3	2.50
00/11/13	2:48	Tille	Middle	1	23.80	23.80	20.00	8.09	8.10	0.10	30.80	30.80	30.00	57.1	56.7	30.0	4.04	4.01	4.02	2.76	2.72	2.75	2	2.50
11/11/13	4:16	Cloudy	Middle	1	24.70	24.70	24.70	8.14	8.14	8.13	31.94	31.95	31.95	58.8	59.8	59.6	4.07	4.14	4.13	1.77	1.82	1.79	<2	<2
11/11/10	4:17	Oloudy	Middle	1	24.70	24.70	24.70	8.11	8.11	0.10	31.95	31.95	01.00	60.2	59.5	00.0	4.17	4.12	4.10	1.80	1.76	1.70	<2	
13/11/13	11:07	Cloudy	Middle	2	23.59	23.59	23.58	7.67	7.67	7.67	31.95	31.95	31.95	56.3	56.4	56.4	3.98	3.98	3.99	1.87	1.87	1.88	5	5.50
16/11/10	11:08	Cidady	Middle	2	23.57	23.57	20.00	7.66	7.66	7.07	31.95	31.95	01100	56.4	56.5		3.99	3.99	0.00	1.88	1.89	1100	6	0.00
15/11/13	12:07	Fine	Middle	2	24.17	24.17	24.18	7.50	7.50	7.50	32.67	32.67	32.67	47.7	47.8	47.9	3.38	3.38	3.39	1.50	1.53	1.54	5	4.50
10/11/10	12:09	T IIIC	Middle	2	24.18	24.18	24.10	7.49	7.49	7.00	32.67	32.67	0L.01	47.9	48.0	47.0	3.39	3.40	0.00	1.55	1.57	1.04	4	4.00
19/11/13	3:20	Cloudy	Middle	1	21.10	21.10	21.10	7.98	7.98	7.98	30.64	30.64	30.65	58.4	58.6	58.3	4.34	4.36	4.34	2.58	2.46	2.47	2	2.50
16/11/10	3:21	Cidady	Middle	1	21.10	21.10	20	7.98	7.98	7.00	30.65	30.65	00.00	58.4	57.9		4.34	4.31		2.43	2.40	2	3	2.00
21/11/13	2:58	Cloudy	Middle	1	21.20	21.20	21.15	8.17	8.17	8.16	30.84	30.84	30.84	54.7	55.2	55.2	4.06	4.10	4.10	1.62	1.57	1.54	4	4.00
2.7.1.7.0	2:59	0.000,	Middle	1	21.10	21.10	20	8.17	8.14	00	30.84	30.84		55.4	55.3		4.12	4.10		1.49	1.49		4	
23/11/13	2:40	Cloudy	Middle	1	21.60	21.60	21.60	8.00	8.00	8.00	31.15	31.15	31.15	49.8	51.3	51.2	3.68	3.78	3.77	1.79	1.80	1.76	<2	<2
	2:41	,	Middle	1	21.60	21.60		8.00	8.00		31.15	31.15		51.6	52.0	*··=	3.80	3.83	-	1.71	1.75		<2	
26/11/13	4:10	Fine	Middle	1	20.50	20.50	20.50	7.81	7.81	7.81	31.79	31.79	31.79	51.0	51.7	51.7	3.81	3.87	3.88	2.06	1.90	1.95	3	3.50
25/11/10	4:11	0	Middle	1	20.50	20.50	20.00	7.81	7.81		31.79	31.79	3	51.9	52.1	····	3.90	3.94	0.50	1.94	1.88		4	0.00

Graphic Presentation of Water Quality Result of C7 - Windsor House

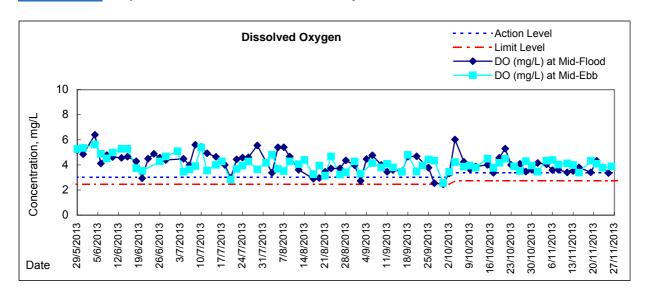

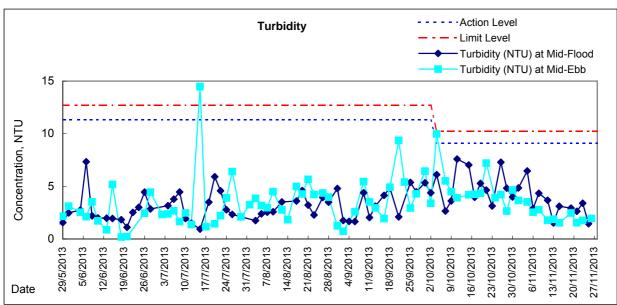

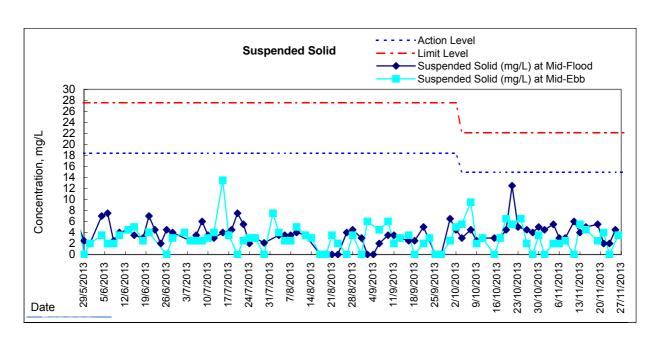

Appendix 6.1

Event Action Plans



Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Event/Action Plan for Construction Noise

EVENT		A	CTION	
	ET	IEC	ER	CONTRACTOR
Action Level	Notify IEC, ER and Contactor Carry out investigation Report the results of investigation to the IEC, ER and Contactor Discuss with the IEC and Contractor on remedial measures required Increase monitoring frequency to check mitigation effectiveness (The above actions should be taken within 2 working days after the exceedance is identified)	Review the investigation results submitted by the ET Review the proposed remedial measures by the Contractor and advise the ER accordingly Advise the ER on the effectiveness of the proposed remedial measures (The above actions should be taken within 2 working days after theexceedance is identified)	Confirm receipt of notification of failure in writing Notify Contractor In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented Supervise the implementation of remedial measures (The above actions should be taken within 2 working days after theexceedance is identified)	Submit noise mitigation proposals to IEC and ER Implement noise mitigation proposals (The above actions should be taken within 2 working days after theexceedance is identified)
Limit Level	Inform IEC, ER, EPD and Contractor Repeat measurement to confirm findings Increase monitoring frequency Identify source and investigate the cause of exceedance Carry out analysis of Contractor's working procedures. Discuss with the IEC, Contractor and ER on remedial measures require Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results If exceedance stops, cease additional monitoring (The above actions should be taken within 2 working days after the exceedance is identified)	Discuss amongst ER, ET and Contractor on the potential remedial actions Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly (The above actions should be taken within 2 working days after theexceedance is identified)	Confirm receipt of notification of failure in writing Notify Contractor In consolidation with the IEC, agree with the Contractor on the remedial measures to be implemented Supervise the implementation of remedial measures If exceedance continues, consider stopping the Contractor to continue working on that portion of work which causes the exceedance until the exceedance is abated (The above actions should be taken within 2 working days after the exceedance is identified)	Take immediate action to avoid further exceedance Submit proposals for remedial actions to IEC and ER within 3 working days of notification Implement the agreed proposals Submit further proposal if problem still not under control Stop the relevant portion of works as instructed by the ER until the exceedance is abated (The above actions should be taken within 2 working days after the exceedance is identified)



Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Event / Action Plan for Construction Air Quality

EVENT		ACTION							
EVENI	ET	IEC	ER	CONTRACTOR					
ACTION LEVEL									
Exceedance for one sample	Identify source, investigate the causes of complaint and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. (The above actions should be taken within 2 working days after the exceedance is identified.)	Check monitoring data submitted by ET; Check Contractor's working method. (The above actions should be taken within 2 working days after the exceedance is identified.)	Notify Contractor. (The above actions should be taken within 2 working days after theexceedance is identified.)	Rectify any unacceptable practice; Amend working methods if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified.)					
Exceedance for two or more consecutive samples	more 2. Inform IEC and ER; 2. Check Contractor's working method;		Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after theexceedance is identified.)	Submit proposals for remedial to ER within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified.)					
LIMIT LEVEL									
Exceedance for one sample	Identify source, investigate the causes ofexceedance and propose remedial measures; Inform IEC, ER, Contractor and EPD; Repeat measurement to confirm finding; Increase monitoring frequency to daily; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. (The above actions should be taken within 2 working days after the exceedance is identified.)	Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ER on the effectiveness of the proposed remedial measures; Supervise implementation of remedial measures. (The above actions should be taken within 2 working days after the exceedance is identified.)	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented. (The above actions should be taken within 2 working days after theexceedance is identified.)	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within three working days of notification; Implement the agreed proposals; Amend proposal if appropriate. (The above actions should be taken within 2 working days after the exceedance is identified.)					



Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

Exceedance for	 Notify IEC, ER, Contractor and EPD; 	 Discuss amongst ER, ET, and Contractor 	 Confirm receipt of notification of 	 Take immediate action to avoid
two or more	Identify source;	on the potential remedial actions;	failure in writing;	further exceedance;
consecutive samples	Repeat measurement to confirm findings;	Review Contractor's remedial actions	Notify Contractor;	Submit proposals for remedial
·	4. Increase monitoring frequency to daily;	whenever necessary to assure their	3. In consultation with the IEC, agree	actions to IEC within three working
	5. Carry out analysis of Contractor's working	effectiveness and advise the ER	with the Contractor on the remedial	days of notification;
	procedures to determine possible mitigation	accordingly;	measures to be implemented;	Implement the agreed proposals;
	to be implemented:	3. Supervise the implementation of remedial	4. Ensure remedial measures properly	Resubmit proposals if problem still
	Arrange meeting with IEC and ER to discuss	measures.	implemented;	not under control:
	the remedial actions to be taken:	(The above actions should be taken within 2	If exceedance continues, consider	Stop the relevant portion of works as
	7. Assess effectiveness of Contractor's remedial	working days after the exceedance is	what portion of the work is	determined by the ER until
	actions and keep IEC, EPD and ER informed	identified.)	responsible and instruct the	the exceedance is abated.
	of the results:	, , , , , , , , , , , , , , , , , , , ,	Contractor to stop that portion of	(The above actions should be taken
	8. If exceedance stops, cease additional		work until the exceedance is	within 2 working days after
	monitoring.		abated.	the exceedance is identified.)
	(The above actions should be taken within 2		(The above actions should be taken	the executance is facilitied.)
	working days after the exceedance is identified.)		within 2 working days after	
	working days after the exceedance is identified.)		theexceedance is identified.)	
			theexocedance is identified.)	



Contract No. HK/2011/07
Wanchai Development Phase II and Central Wanchai Bypass
(Shatin to Central Link (SCL) Protection
Works at Causeway Bay Typhoon Shelter)

Event and Action Plan for Marine Water Quality

EVENT	ACTION									
	ET	IEC	ER	CONTRACTOR						
Action level being exceeded by one sampling day	Repeat in-situ measurement to confirm findings; Identify source(s) of impact; Inform IEC and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; (The above actions should be taken within 1 working day after the exceedance is identified) Repeat measurement on next day of exceedance.	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER; Implement the agreed mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)						
Action level being exceeded by more than one consecutive sampling days	Identify source(s) of impact; Inform IEC and Contractor; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; Ensure mitigation measures are implemented; Prepare to increase the monitoring frequency to daily; (The above actions should be taken within 1 working day after the exceedance is identified) Repeat measurement on next working day of exceedance.	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC on the proposed mitigation measures; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the Engineer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET and IEC and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)						



Contract No. HK/2011/07 Wanchai Development Phase II and Central Wanchai Bypass (Shatin to Central Link (SCL) Protection Works at Causeway Bay Typhoon Shelter)

EVENT		ACTION							
	ET	IEC	ER	CONTRACTOR					
Limit level being exceeded by one sampling day	Repeat in-situ measurement to confirm findings; Identify source(s) of impact; Inform IEC and Contractor and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the Engineer and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3 working days; Implement the agreed mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)					
Limit level being exceeded by more than one consecutive sampling days	Identify source(s) of impact; Inform IEC, contractor and EPD; Check monitoring data, all plant, equipment and Contractor's working methods; Discuss mitigation measures with IEC, ER and Contractor; Ensure mitigation measures are implemented; Increase the monitoring frequency to daily until no exceedance of Limit level for two consecutive days. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with ET and Contractor on the mitigation measures; Review proposals on mitigation measures submitted by Contractor and advise the ER accordingly; Assess the effectiveness of the implemented mitigation measures. (The above actions should be taken within 1 working day after the exceedance is identified)	Discuss with IEC, ET and Contractor on the proposed mitigation measures; Request Contractor to critically review the working methods; Make agreement on the mitigation measures to be implemented; Assess the effectiveness of the implemented mitigation measures; Consider and instruct, if necessary, the Contractor to slow down or to stop all or part of the marine work until no exceedance of Limit level. (The above actions should be taken within 1 working day after the exceedance is identified)	Inform the ER and confirm notification of the non-compliance in writing; Rectify unacceptable practice; Check all plant and equipment; Consider changes of working methods; Discuss with ET, IEC and ER and propose mitigation measures to IEC and ER within 3working days; Implement the agreed mitigation measures; As directed by the Engineer, to slow down or to stop all or part of the marine work or construction activities. (The above actions should be taken within 1 working day after the exceedance is identified)					

Appendix 6.2

Summary of Notification of Exceedances

Ref no.	Date	Tidal	Location	Parameters (Unit)	Measured	Action Leve	Limit Level	Follow-up action	
X_10C601	25-Nov-13	Mid-flood	C7	DO(mg/L)	3.35	3.36	2.73		Natural variation or changes of water quality in the vicinity of the water quality monitoring station
				Turbidity	1.45	9.10			Immediate repeated in-situ measurements had conducted to confirm the exceedances. Checking with contractor's works. Checking with contractor's inspection record.
				SS	4.50	15.00	22.13		Silt screen was in proper condition. In view of no marine works was conducted in the vincity of the monitoring location on monitoring day and no further exceedance was recorded in the next consecutive monitoring, the exceedance was considered not project related.

Appendix 7.1

Complaint Log



Environmental Complaints Log

Complaint Log No.	Date of Complaint	Received From and Received By	Nature of Complaint	Outcome	Status
-			 	-	

Appendix 8.1

Construction Programme of Individual Contracts

ctivity ID	Activity Name	Calendar	Original Duration	Start	Finish	Late Start	Late Finish	Total Float	
			Durauun						Q3 Q4 Q1 Q2 Q3 Q
	CCT RC Structure								
S26740	TS4/ME4 - CWB CCT (+ STITCHING) SUMMARY	7d/wk-1	93	25-Aug-13	28-Nov-13	22-Mar-13	29-Jul-13	-119	TS4/ME4 - CWB CCT (+ STITCHING) SUMMARY
S26735	TS4/ME4 - SCL CCT SUMMARY	7d/wk-1	67	22-Oct-13	29-Dec-13,	22-May-13	29-Jul-13	-148	TS4/ME4 SCLICCT \$UMM/ARY
CCT (Hal	f - near Mined Tunnel) (Total 11 bays, at 5m/bay)								
S26765	TS4 Construct tunnel base slab	7d/wk-1	24	17-Sep-13*	12-Oct-13	18-Apr-13	12-May-13	-148	■ TS4 Construct Junnel base slab
S26770	TS4 Construct tunnel wall & roof slab	7d/wk-1	36	30-Sep-13*	06-Nov-13*	30-Apr-13	06-Jun-13	-148	TS4 Construct tunnel wall & roof slab
826780	TS4 King post load transfer	7d/wk-1	24	20-Oct-13	12-Nov-13	20-May-13	13-Jun-13	-148	■ TS4 King post load transfer
S26785	TS4 waterproofing	7d/wk-1	26	23-Oct-13	17-Nov-13	23-May-13	18-Jun-13	-148	■ 1S4 waterproofing
S26775	TS4 fill to underside of SCL tunnel	7d/wk-1	6	15-Nov-13	20-Nov-13	16-Jun-13	21-Jun-13	-148	I 1S4 fill to underside of SCL turnel
Stitching	(MT Lining connects with CCT)								
S26825	WB - stitching (wall & roof)	7d/wk-1	48	17-Sep-13	06-Nov-13	10-Jun-13	29-Jul-13	-97	WB - stitching (wall & roof)
\$26835	SR8 - stitching (wall & roof)	7d/wk-1	48	03-Oct-13	20-Nov-13	10-Jun-13	29-Jul-13	-111	SR8 - stitching (wall & roof)
S26830	EB - stitching (wall & roof)	7d/wk-1	48	11-Oct-13	28-Nov-13	10-Jun-13	29-Jul-13	-119	EB - stitching (wall & roof)
CCT (Re	maining Half- East Side) (Total 11 bays, at 5m/bay)				TO STATE	To The State of th			
S26815	TS4 Construct tunnel base slab (after -35)	7d/wk-1	24	25-Aug-13	17-Sep-13	22-Mar-13	18-Apr-13	-148	TS4 Constluct tunnel blase slab (after -95)
S26820	TS4 Construct tunnel wall & roof slab	7d/wk-1	36	13-Sep-13	21-Oct-13*	09-May-13	15-Jun-13	-124	TS4 Construct tunnel wall & roof stab
	RC Structure		TE 5						
S26745	ME4 - SCL tunnel, base slab	7d/wk-1	48	22-Oct-13	08-Dec-13	22-May-13	10-Jul-13	-148	ME4 - SCL tunnel, base slab
\$26750	ME4 - SCL tunnel, wall and roof slab	7d/wk-1	48	01-Nov-13	18-Dec-13	01-Jun-13	20-Jul-13	-148	ME4-SCL tunnel, wall and mof stab
S26760	TS4/ME4 - external waterproofing on top of completed CCT box (incl. screeding)	7d/wk-1	24	30-Nov-13	23-Dec-13	02-Jul-13	25-Jul-13	-148	TS4/ME4 external waterproofing on top of completed CCT box (inc
S26755	TS4/ME4 - Backfilling works on top of completed CCT box (incl. screeding)	7d/wk-1	26	02-Dec-13	29-Dec-13	04-Jul-13	29-Jul-13	-148	TS4/ME4 - Backfilling works on top of completed CQT box (incl. scr
	Actual Work 7 of 22								Prepared by William Caluza
	riction from								Date Revision Chec App
	Remaining Work								09-Nov-12 WP Rev. I DL
	Critical Remaini China State Const	ruction E	nginee	ring (Hon	g Kong) L	.ta			
	Summary								中國運募工程(春洋)分位公
	Summay Contract No. HY/2009/15 - Central Wan Cha	ai By Pass	- Tuni	nel (Caus	eway Bay	Typhoon	Shelter S	Section)	CHINASTATE CONSTRUCTION ENGIG. HONG HONG
• •	Remaining Work								
• •	Milestone WORKS	PROG	RAN	MME RE	EV. I				
•	WORK	11100	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	11411-171	- • • •				